-26dB Bandwidth NVNT n40 5510MHz Ant1

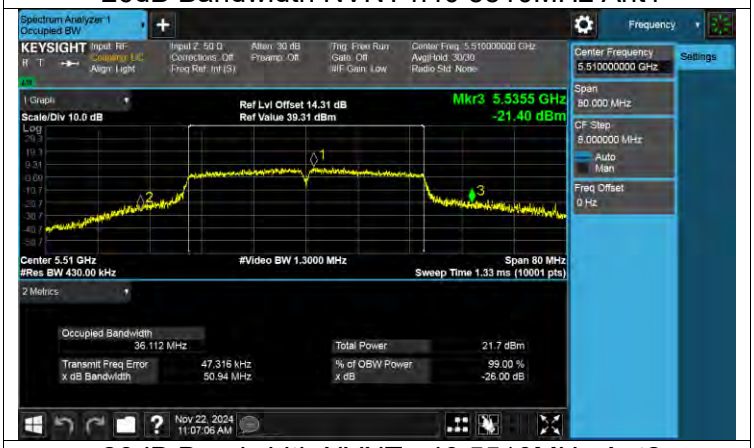

-26dB Bandwidth NVNT n40 5510MHz Ant2

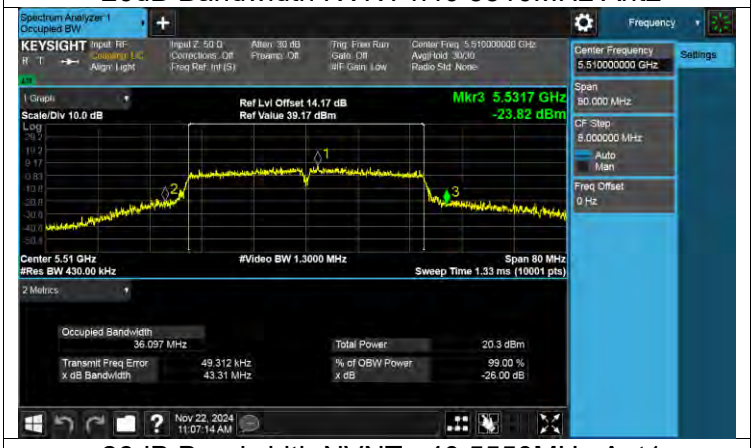

-26dB Bandwidth NVNT n40 5550MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT n40 5550MHz Ant2

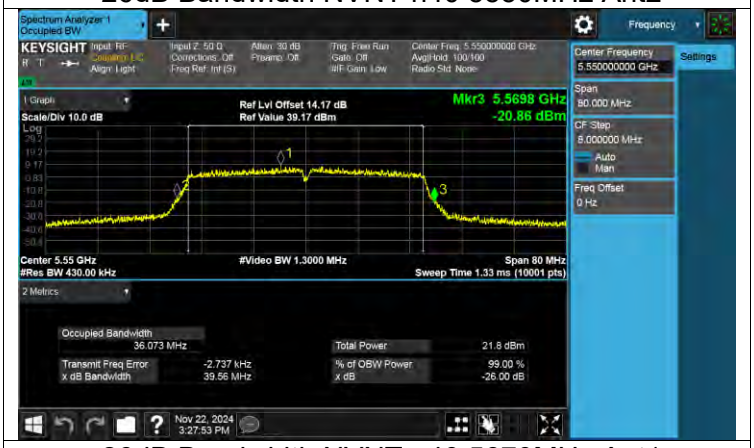

-26dB Bandwidth NVNT n40 5670MHz Ant1

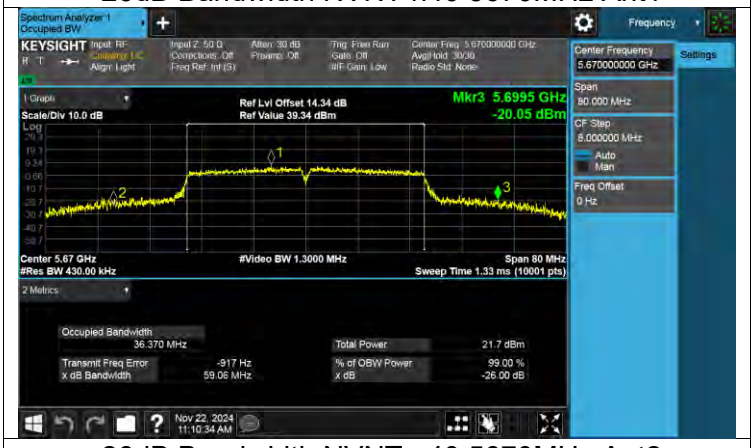

-26dB Bandwidth NVNT n40 5670MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT n40 5710MHz Ant1

-26dB Bandwidth NVNT n40 5710MHz Ant2

-26dB Bandwidth NVNT n40 5755MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT n40 5755MHz Ant2

-26dB Bandwidth NVNT n40 5795MHz Ant1

-26dB Bandwidth NVNT n40 5795MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ac80 5210MHz Ant1

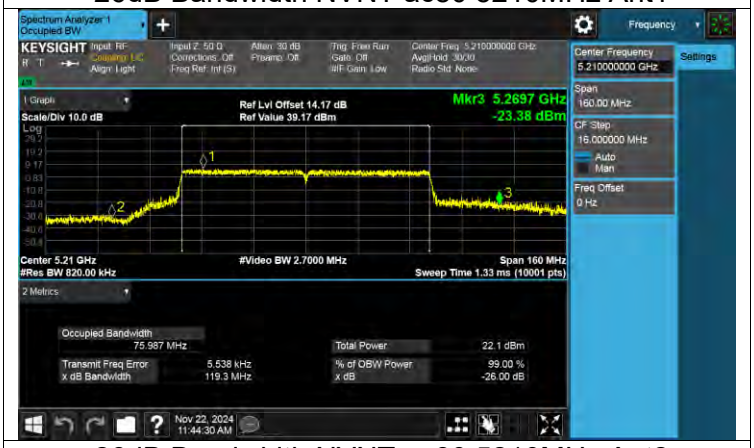

-26dB Bandwidth NVNT ac80 5210MHz Ant2

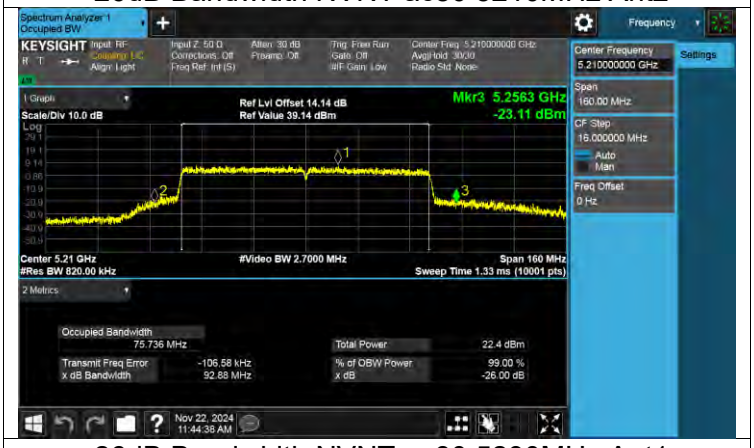

-26dB Bandwidth NVNT ac80 5290MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ac80 5290MHz Ant2

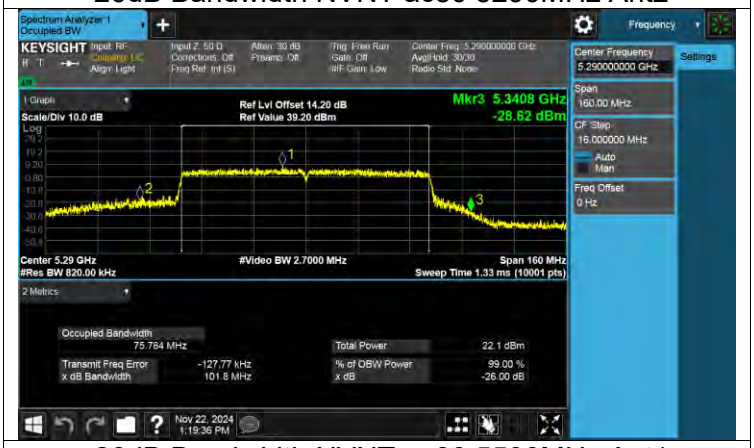

-26dB Bandwidth NVNT ac80 5530MHz Ant1

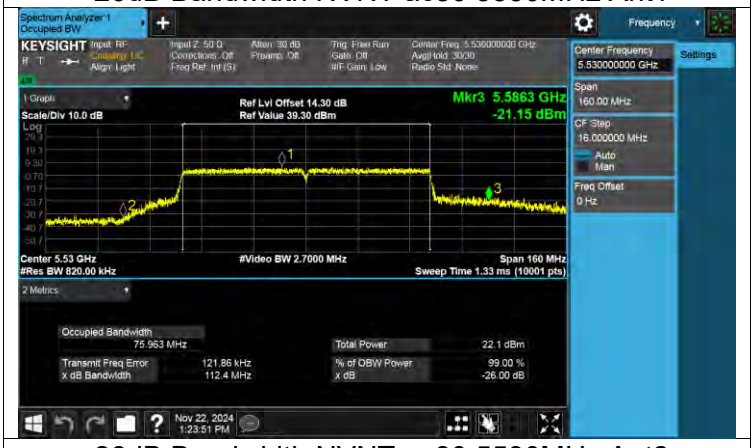

-26dB Bandwidth NVNT ac80 5530MHz Ant2

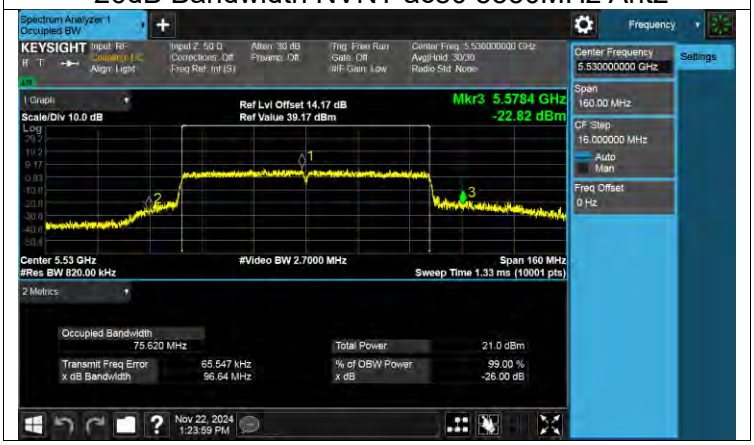

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ac80 5610MHz Ant1

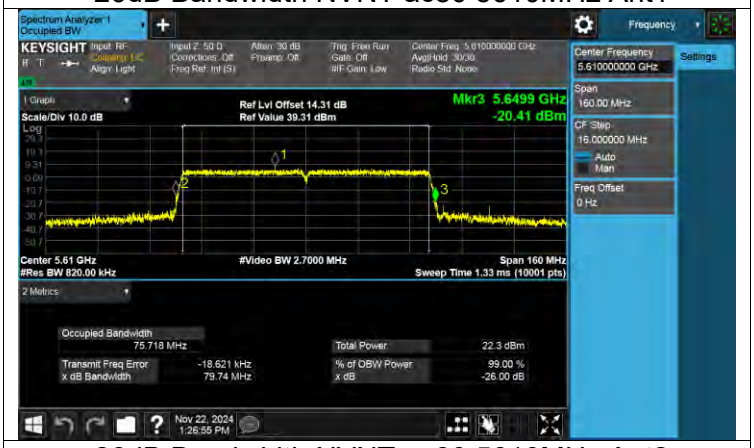

-26dB Bandwidth NVNT ac80 5610MHz Ant2

-26dB Bandwidth NVNT ac80 5690MHz Ant1

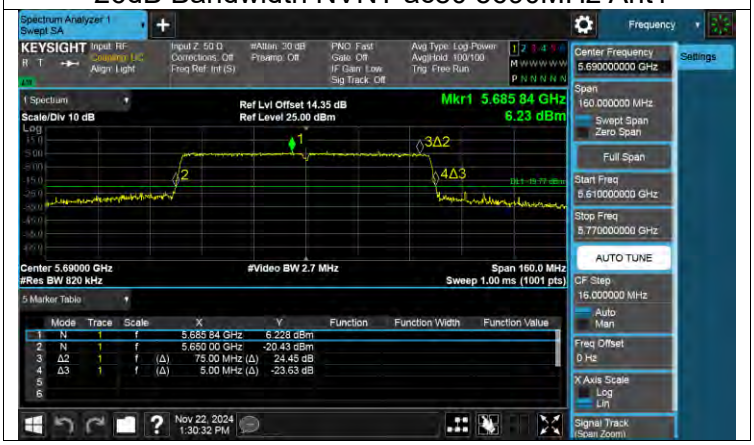

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ac80 5690MHz Ant2

-26dB Bandwidth NVNT ac80 5775MHz Ant1

-26dB Bandwidth NVNT ac80 5775MHz Ant2

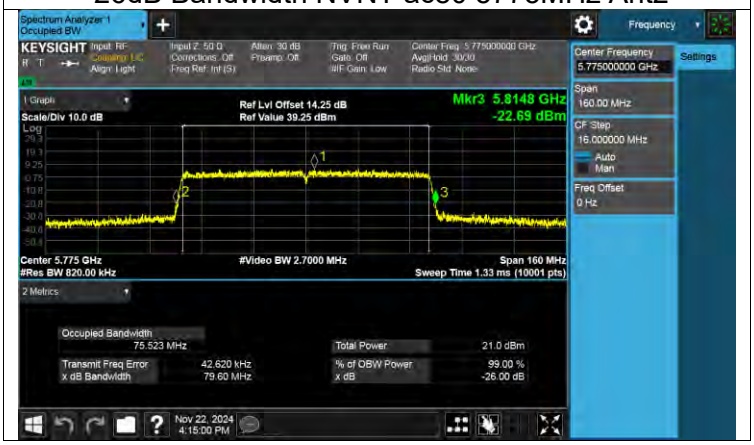

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax20 5180MHz Ant1

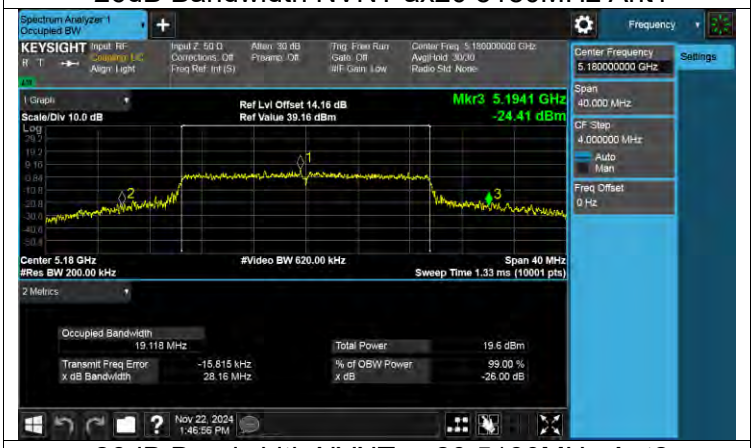

-26dB Bandwidth NVNT ax20 5180MHz Ant2

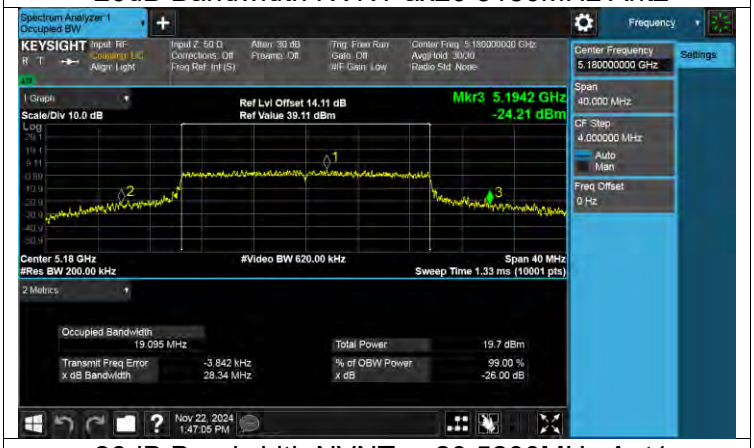

-26dB Bandwidth NVNT ax20 5200MHz Ant1

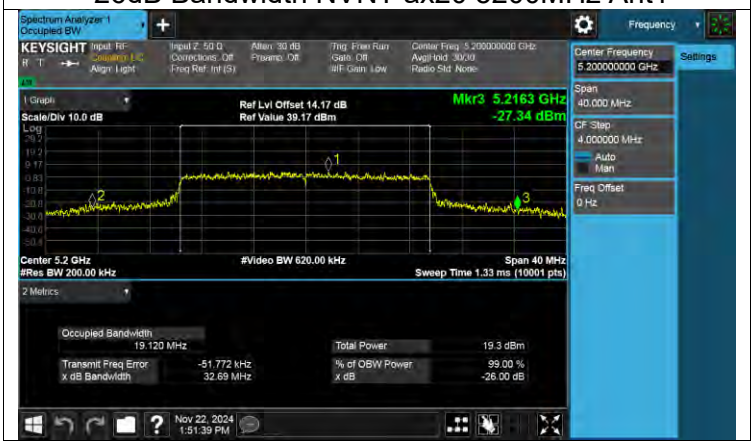

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax20 5200MHz Ant2

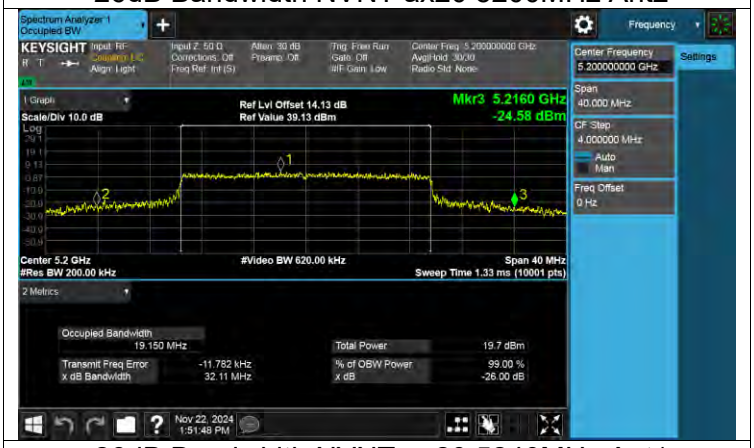

-26dB Bandwidth NVNT ax20 5240MHz Ant1

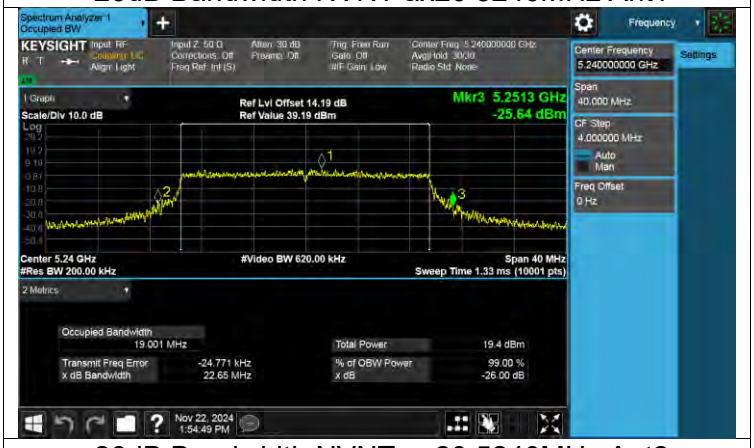

-26dB Bandwidth NVNT ax20 5240MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax20 5260MHz Ant1

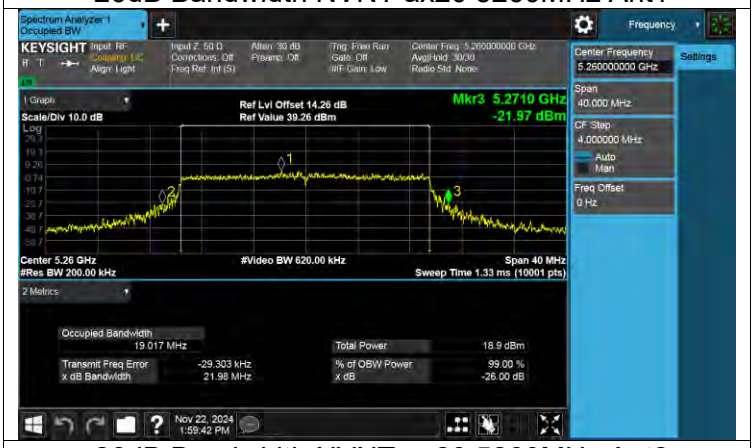

-26dB Bandwidth NVNT ax20 5260MHz Ant2

-26dB Bandwidth NVNT ax20 5280MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax20 5280MHz Ant2

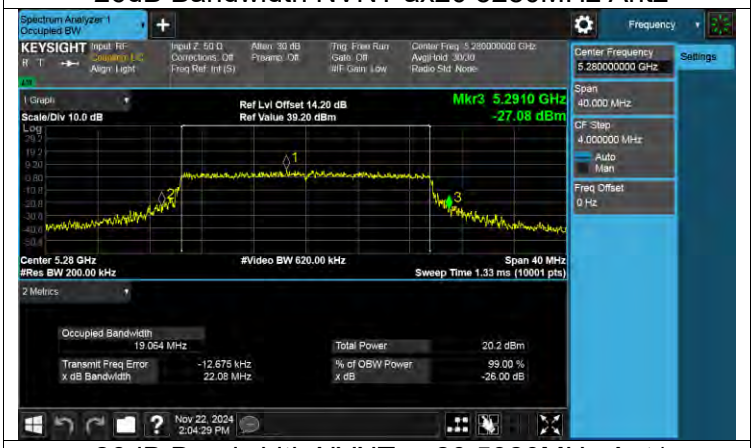

-26dB Bandwidth NVNT ax20 5320MHz Ant1

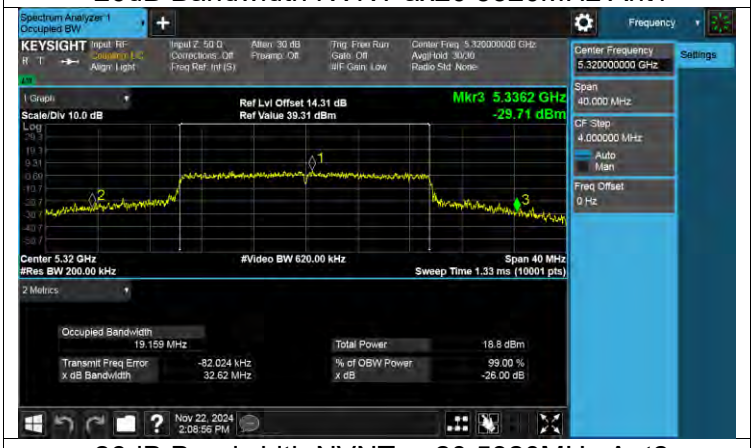

-26dB Bandwidth NVNT ax20 5320MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax20 5500MHz Ant1

-26dB Bandwidth NVNT ax20 5500MHz Ant2

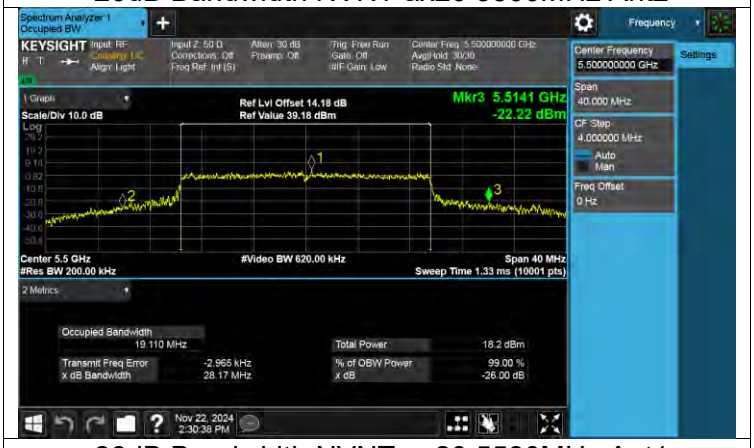

-26dB Bandwidth NVNT ax20 5580MHz Ant1

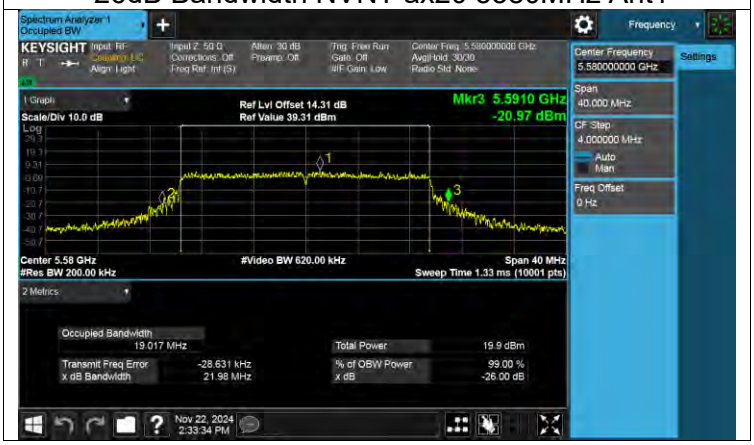

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax20 5580MHz Ant2

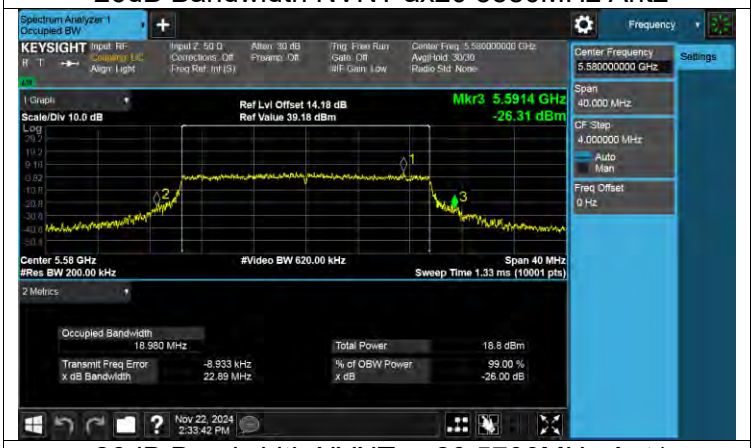

-26dB Bandwidth NVNT ax20 5700MHz Ant1

-26dB Bandwidth NVNT ax20 5700MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax20 5720MHz Ant1

-26dB Bandwidth NVNT ax20 5720MHz Ant2

-26dB Bandwidth NVNT ax20 5745MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax20 5745MHz Ant2

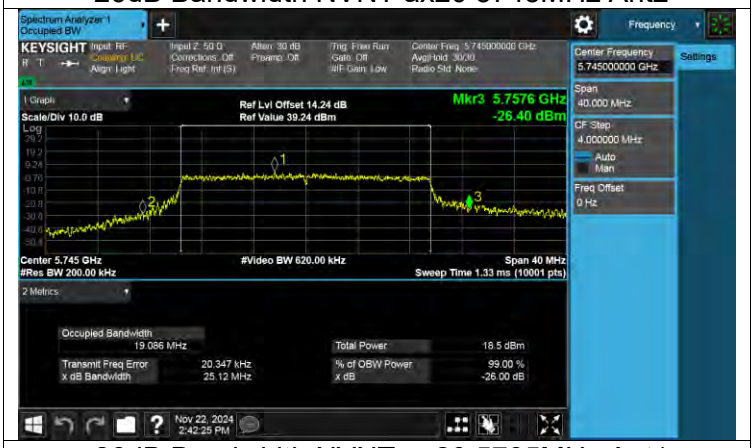

-26dB Bandwidth NVNT ax20 5785MHz Ant1

-26dB Bandwidth NVNT ax20 5785MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax20 5825MHz Ant1

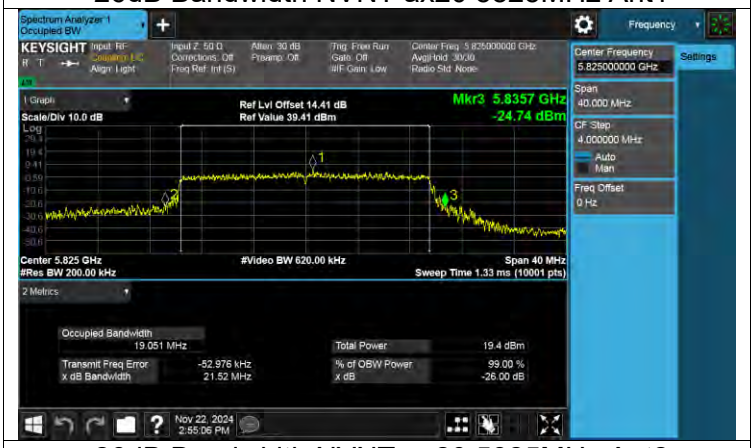

-26dB Bandwidth NVNT ax20 5825MHz Ant2

-26dB Bandwidth NVNT ax40 5190MHz Ant1

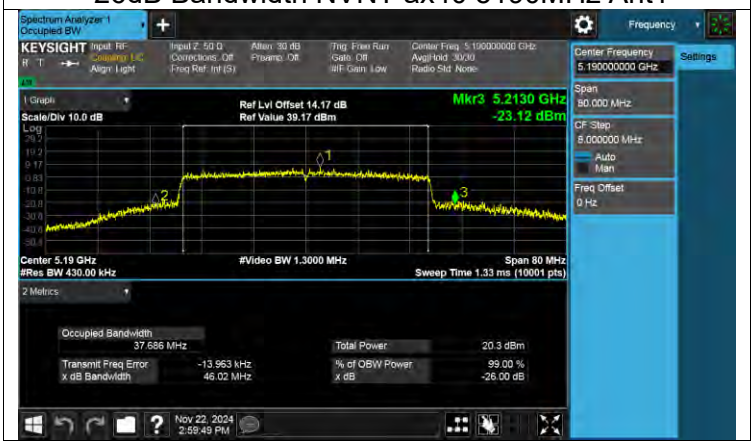

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax40 5190MHz Ant2

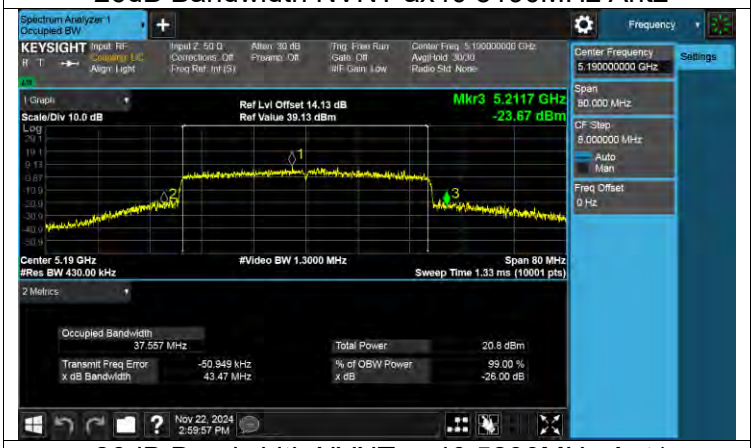

-26dB Bandwidth NVNT ax40 5230MHz Ant1

-26dB Bandwidth NVNT ax40 5230MHz Ant2

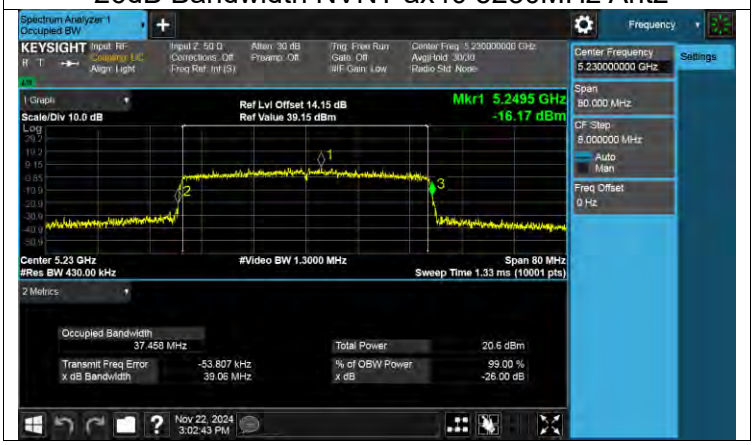

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax40 5270MHz Ant1

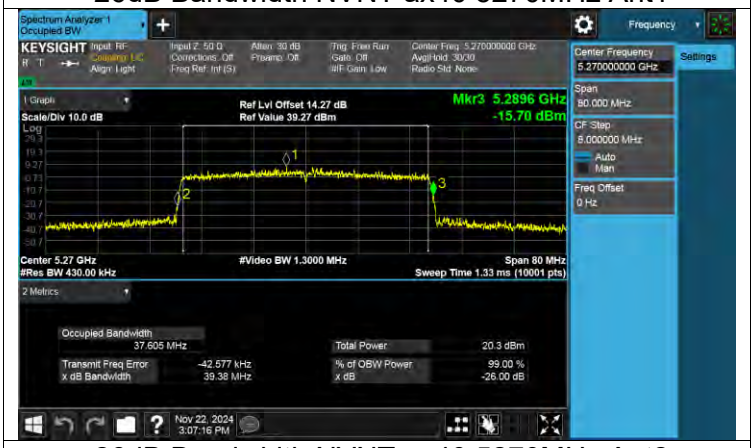

-26dB Bandwidth NVNT ax40 5270MHz Ant2

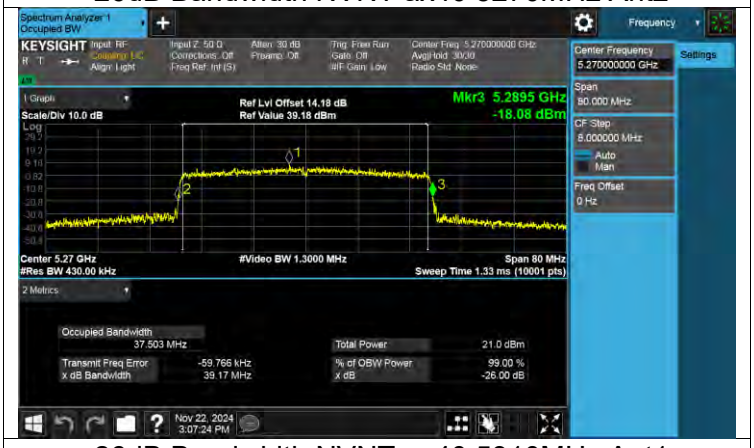

-26dB Bandwidth NVNT ax40 5310MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax40 5310MHz Ant2

-26dB Bandwidth NVNT ax40 5510MHz Ant1

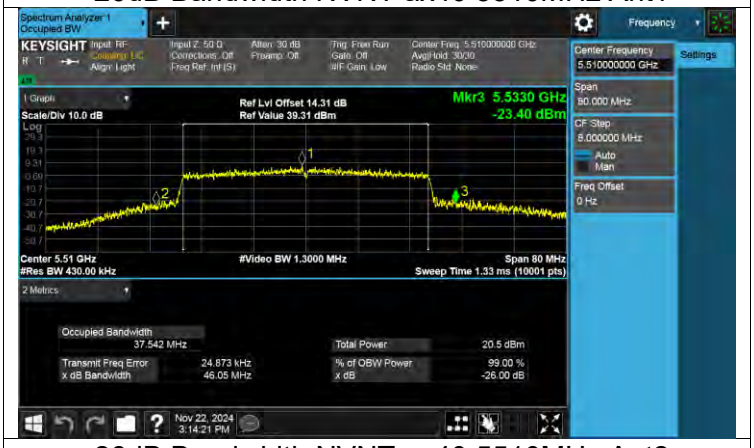

-26dB Bandwidth NVNT ax40 5510MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax40 5550MHz Ant1

-26dB Bandwidth NVNT ax40 5550MHz Ant2

-26dB Bandwidth NVNT ax40 5670MHz Ant1

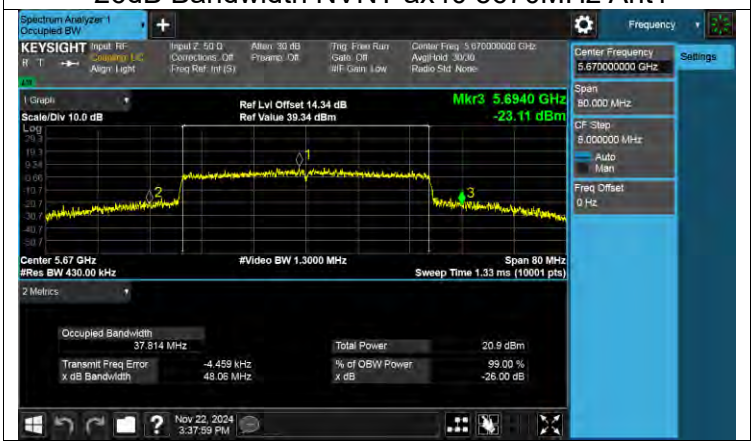

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax40 5670MHz Ant2

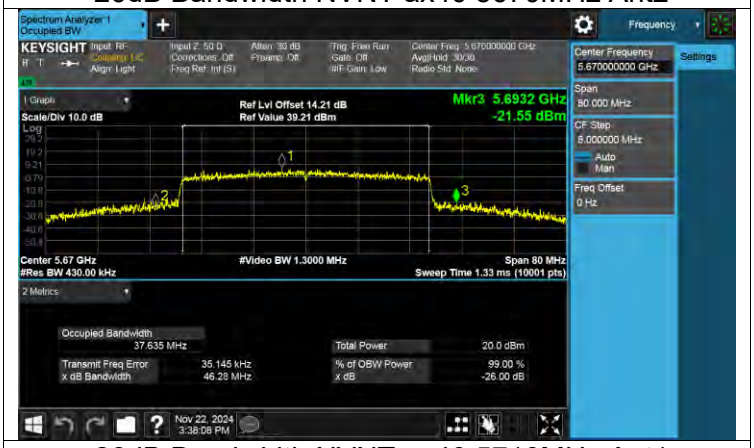

-26dB Bandwidth NVNT ax40 5710MHz Ant1

-26dB Bandwidth NVNT ax40 5710MHz Ant2

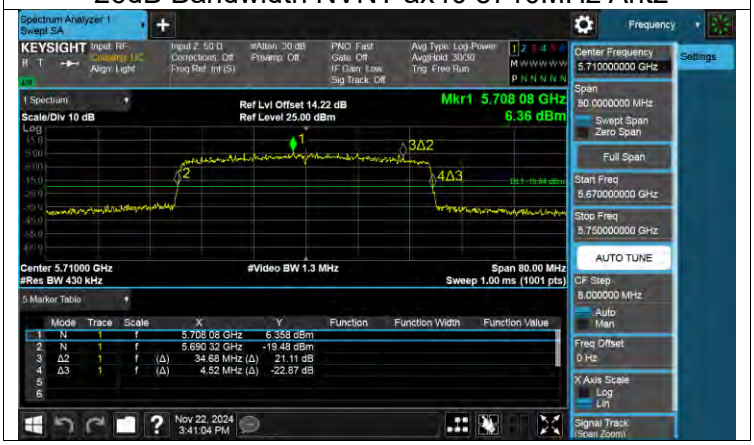

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax40 5755MHz Ant1

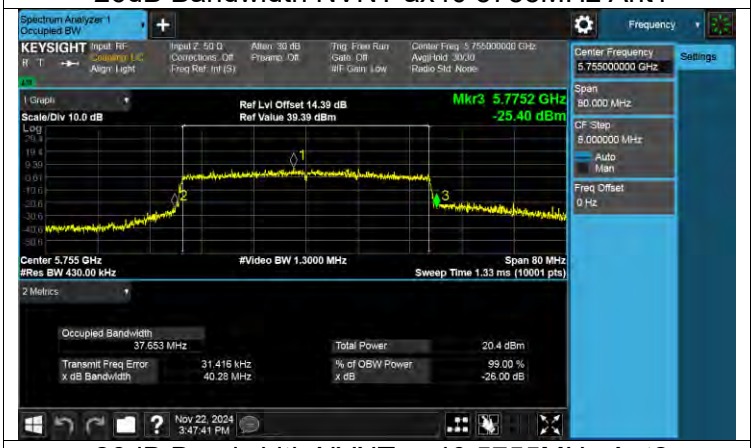

-26dB Bandwidth NVNT ax40 5755MHz Ant2

-26dB Bandwidth NVNT ax40 5795MHz Ant1

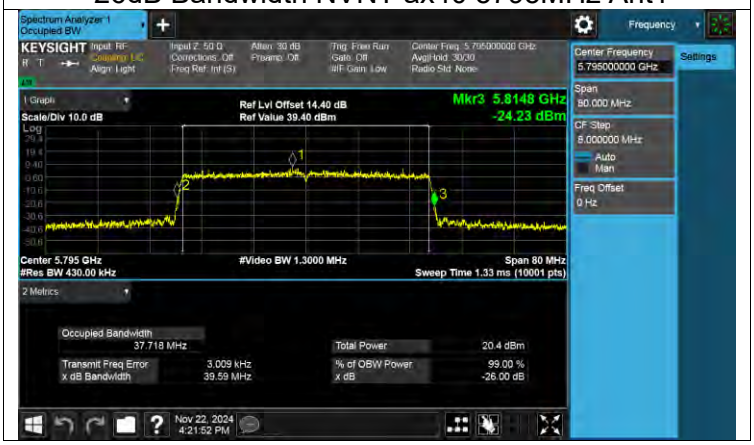

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax40 5795MHz Ant2

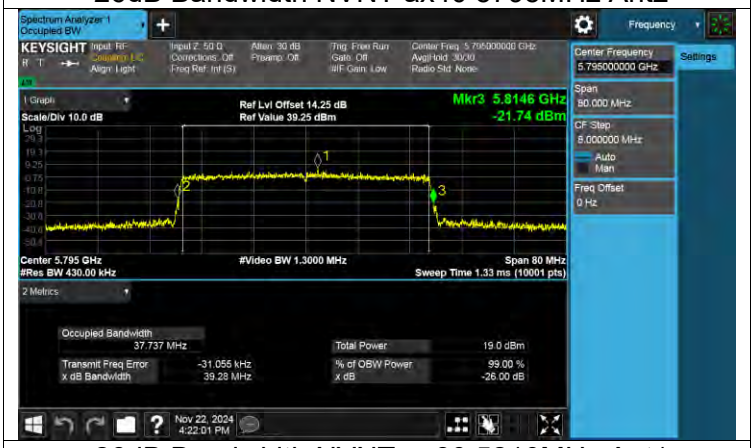

-26dB Bandwidth NVNT ax80 5210MHz Ant1

-26dB Bandwidth NVNT ax80 5210MHz Ant2

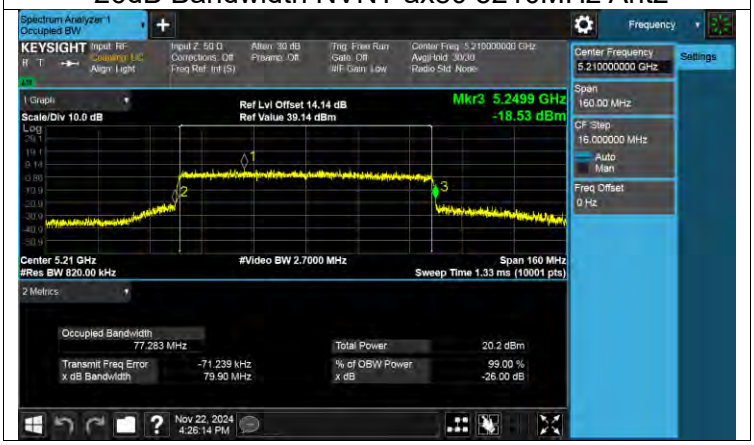

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax80 5290MHz Ant1

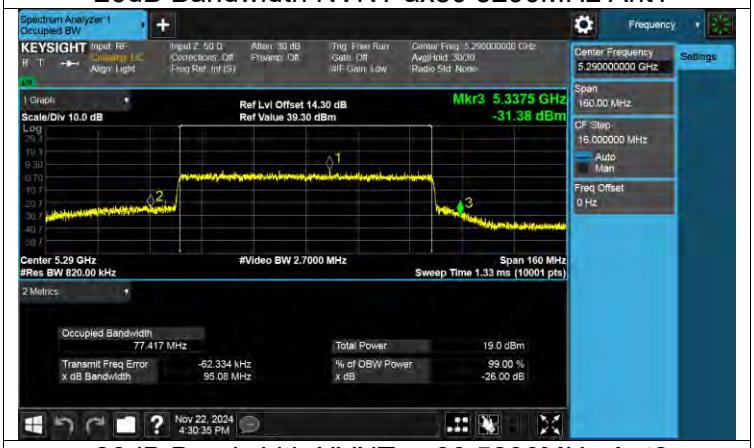

-26dB Bandwidth NVNT ax80 5290MHz Ant2

-26dB Bandwidth NVNT ax80 5530MHz Ant1

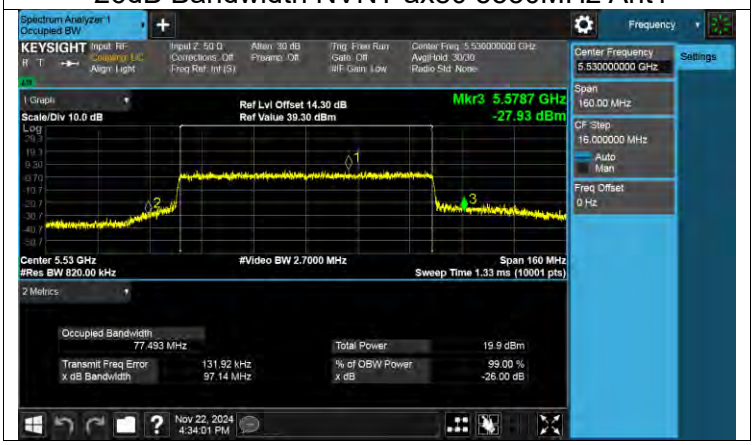

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax80 5530MHz Ant2

-26dB Bandwidth NVNT ax80 5610MHz Ant1

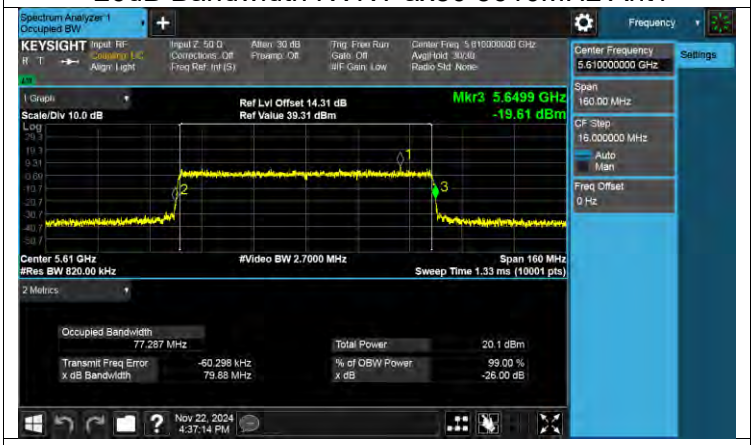

-26dB Bandwidth NVNT ax80 5610MHz Ant2

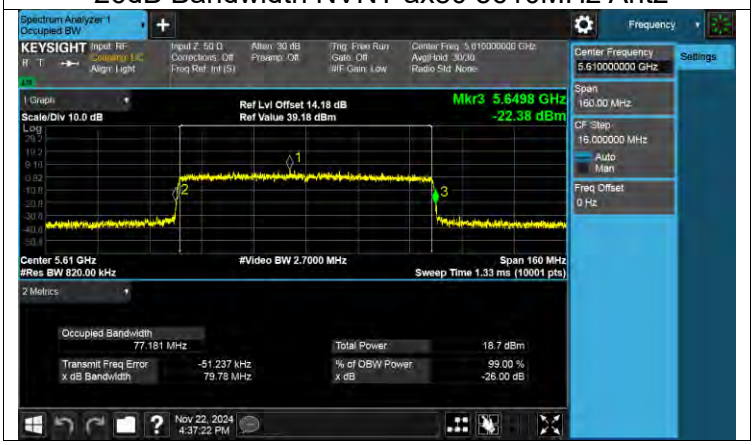

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax80 5690MHz Ant1

-26dB Bandwidth NVNT ax80 5690MHz Ant2

-26dB Bandwidth NVNT ax80 5775MHz Ant1

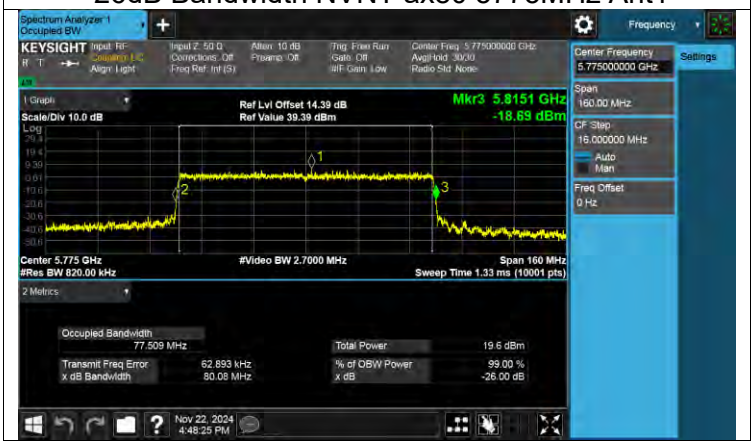

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

-26dB Bandwidth NVNT ax80 5775MHz Ant2

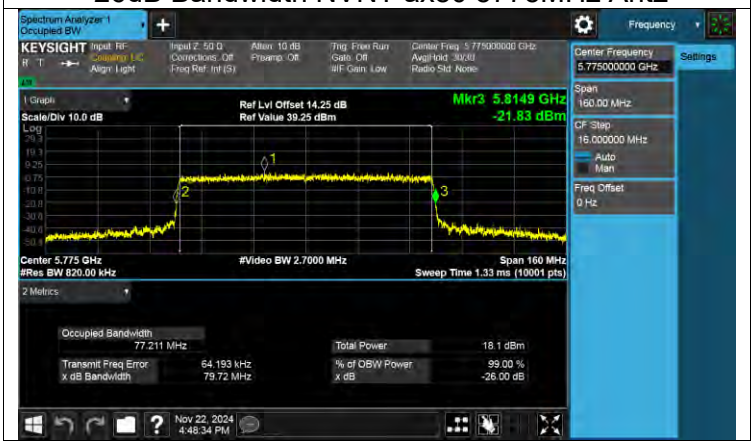

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

Appendix D:Occupied Channel Bandwidth

Mode	Frequency (MHz)	Antenna	99% OBW (MHz)
a	5180	Ant1	16.775
a	5180	Ant2	16.806
a	5200	Ant1	16.842
a	5200	Ant2	16.832
a	5240	Ant1	16.591
a	5240	Ant2	16.53
a	5260	Ant1	16.548
a	5260	Ant2	16.558
a	5280	Ant1	16.576
a	5280	Ant2	16.586
a	5320	Ant1	16.836
a	5320	Ant2	16.881
a	5500	Ant1	16.822
a	5500	Ant2	16.754
a	5580	Ant1	16.57
a	5580	Ant2	16.546
a	5700	Ant1	16.754
a	5700	Ant2	16.859
a	5720 Low	Ant1	13.3555
a	5720 High	Ant1	3.3555
a	5720 Low	Ant2	13.379
a	5720 High	Ant2	3.379
a	5745	Ant1	16.78
a	5745	Ant2	16.736
a	5785	Ant1	16.585
a	5785	Ant2	16.56
a	5825	Ant1	16.564
a	5825	Ant2	16.571
n20	5180	Ant1	18.008
n20	5180	Ant2	17.922
n20	5200	Ant1	17.953
n20	5200	Ant2	18.007
n20	5240	Ant1	17.736
n20	5240	Ant2	17.727
n20	5260	Ant1	17.75
n20	5260	Ant2	17.721
n20	5280	Ant1	17.812
n20	5280	Ant2	17.775
n20	5320	Ant1	18.099
n20	5320	Ant2	18.003
n20	5500	Ant1	18.003
n20	5500	Ant2	17.993
n20	5580	Ant1	17.767
n20	5580	Ant2	17.769
n20	5700	Ant1	18.072
n20	5700	Ant2	17.935
n20	5720 Low	Ant1	13.989
n20	5720 High	Ant1	3.989

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

n20	5720 Low	Ant2	13.9585
n20	5720 High	Ant2	3.9585
n20	5745	Ant1	17.971
n20	5745	Ant2	17.921
n20	5785	Ant1	17.81
n20	5785	Ant2	17.74
n20	5825	Ant1	17.78
n20	5825	Ant2	17.78
n40	5190	Ant1	36.195
n40	5190	Ant2	36.109
n40	5230	Ant1	36.067
n40	5230	Ant2	36.011
n40	5270	Ant1	36.069
n40	5270	Ant2	36.05
n40	5310	Ant1	36.236
n40	5310	Ant2	36.151
n40	5510	Ant1	36.283
n40	5510	Ant2	36.047
n40	5550	Ant1	36.066
n40	5550	Ant2	36.065
n40	5670	Ant1	36.369
n40	5670	Ant2	36.186
n40	5710 Low	Ant1	33.0785
n40	5710 High	Ant1	3.0785
n40	5710 Low	Ant2	33.0105
n40	5710 High	Ant2	3.0105
n40	5755	Ant1	36.193
n40	5755	Ant2	36.031
n40	5795	Ant1	36.069
n40	5795	Ant2	35.986
ac80	5210	Ant1	75.999
ac80	5210	Ant2	75.74
ac80	5290	Ant1	75.998
ac80	5290	Ant2	75.712
ac80	5530	Ant1	75.949
ac80	5530	Ant2	75.701
ac80	5610	Ant1	75.801
ac80	5610	Ant2	75.543
ac80	5690 Low	Ant1	72.8815
ac80	5690 High	Ant1	2.8815
ac80	5690 Low	Ant2	72.734
ac80	5690 High	Ant2	2.734
ac80	5775	Ant1	75.839
ac80	5775	Ant2	75.553
ax20	5180	Ant1	19.096
ax20	5180	Ant2	19.076
ax20	5200	Ant1	19.164
ax20	5200	Ant2	19.242
ax20	5240	Ant1	18.991
ax20	5240	Ant2	19.001
ax20	5260	Ant1	18.986

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

ax20	5260	Ant2	19.016
ax20	5280	Ant1	19.055
ax20	5280	Ant2	19.019
ax20	5320	Ant1	19.107
ax20	5320	Ant2	19.174
ax20	5500	Ant1	19.068
ax20	5500	Ant2	19.149
ax20	5580	Ant1	19.021
ax20	5580	Ant2	19.021
ax20	5700	Ant1	19.094
ax20	5700	Ant2	19.163
ax20	5720 Low	Ant1	14.5255
ax20	5720 High	Ant1	4.5255
ax20	5720 Low	Ant2	14.526
ax20	5720 High	Ant2	4.526
ax20	5745	Ant1	19.092
ax20	5745	Ant2	19.114
ax20	5785	Ant1	18.988
ax20	5785	Ant2	18.97
ax20	5825	Ant1	19.022
ax20	5825	Ant2	18.992
ax40	5190	Ant1	37.666
ax40	5190	Ant2	37.649
ax40	5230	Ant1	37.592
ax40	5230	Ant2	37.494
ax40	5270	Ant1	37.559
ax40	5270	Ant2	37.565
ax40	5310	Ant1	37.67
ax40	5310	Ant2	37.695
ax40	5510	Ant1	37.683
ax40	5510	Ant2	37.498
ax40	5550	Ant1	37.605
ax40	5550	Ant2	37.576
ax40	5670	Ant1	37.752
ax40	5670	Ant2	37.652
ax40	5710 Low	Ant1	33.768
ax40	5710 High	Ant1	3.768
ax40	5710 Low	Ant2	33.7505
ax40	5710 High	Ant2	3.7505
ax40	5755	Ant1	37.68
ax40	5755	Ant2	37.604
ax40	5795	Ant1	37.739
ax40	5795	Ant2	37.728
ax80	5210	Ant1	77.505
ax80	5210	Ant2	77.259
ax80	5290	Ant1	77.578
ax80	5290	Ant2	77.285
ax80	5530	Ant1	77.478
ax80	5530	Ant2	77.071
ax80	5610	Ant1	77.322
ax80	5610	Ant2	77.137

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

ax80	5690 Low	Ant1	73.6945
ax80	5690 High	Ant1	3.6945
ax80	5690 Low	Ant2	73.583
ax80	5690 High	Ant2	3.583
ax80	5775	Ant1	77.437
ax80	5775	Ant2	77.187

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

Test Graphs

OBW NVNT a 5180MHz Ant1

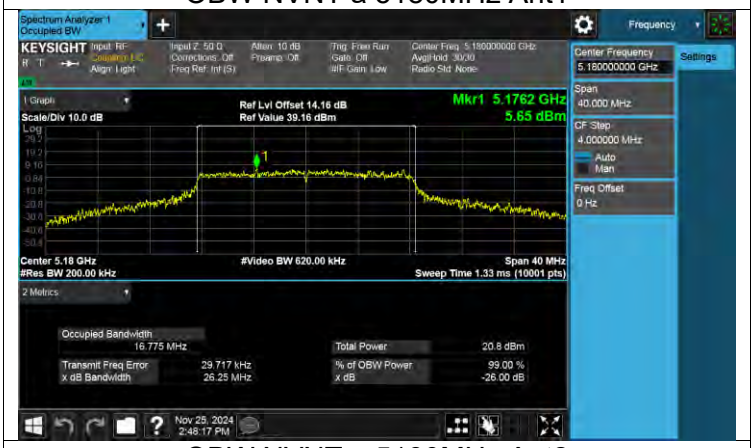

OBW NVNT a 5180MHz Ant2

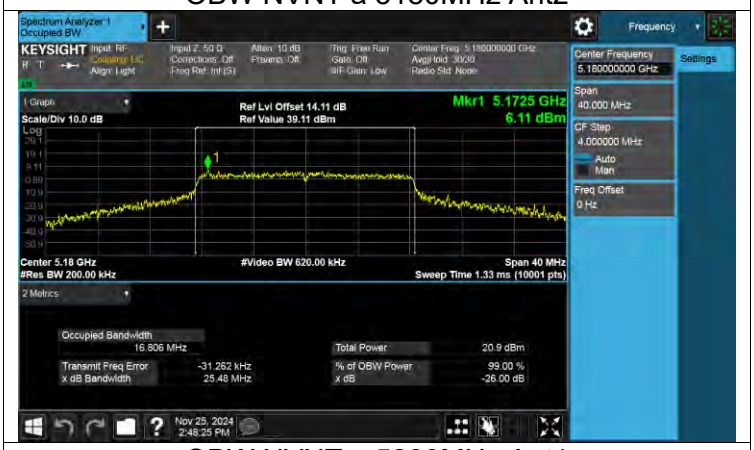

OBW NVNT a 5200MHz Ant1

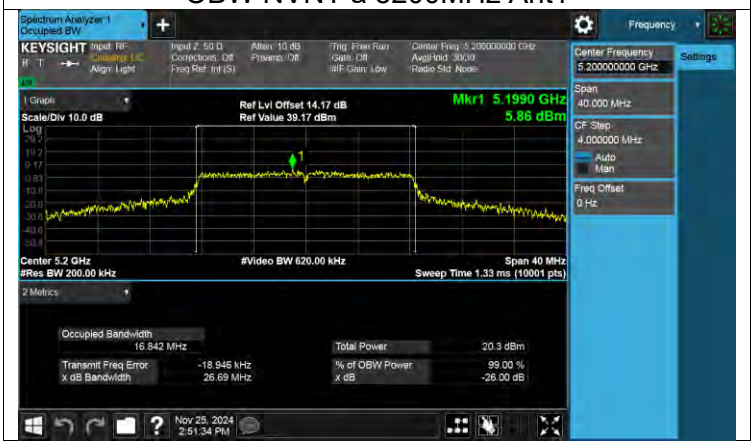

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT a 5200MHz Ant2

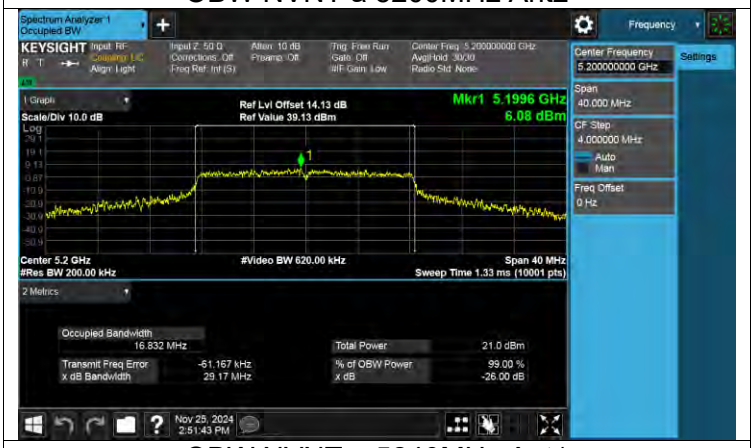

OBW NVNT a 5240MHz Ant1

OBW NVNT a 5240MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT a 5260MHz Ant1

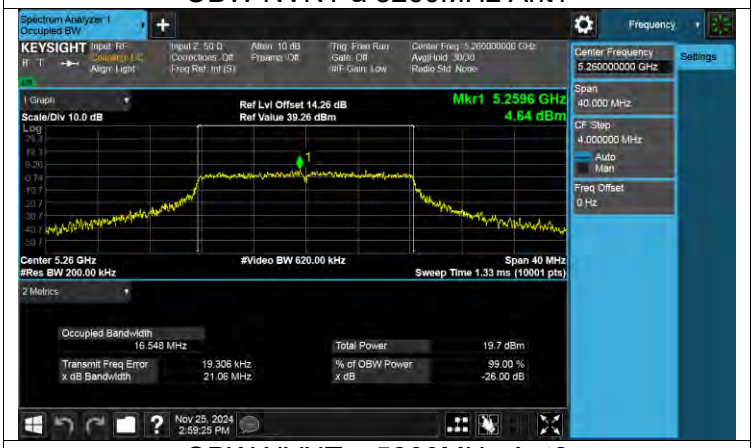

OBW NVNT a 5260MHz Ant2

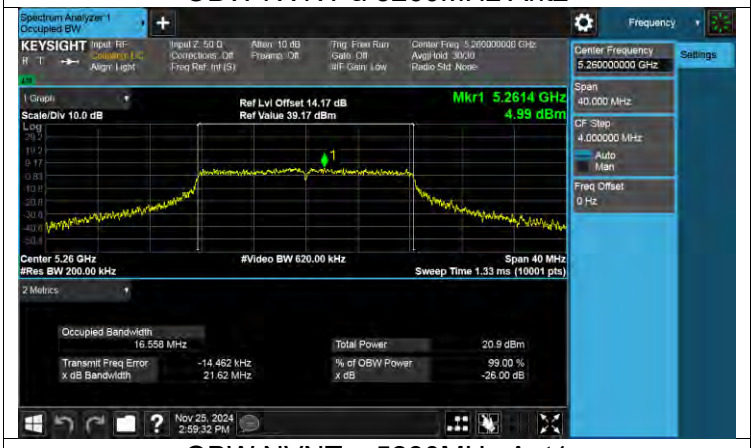

OBW NVNT a 5280MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT a 5280MHz Ant2

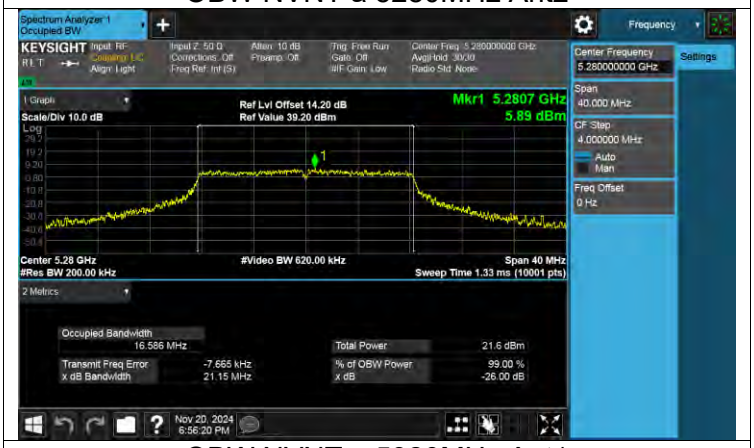

OBW NVNT a 5320MHz Ant1

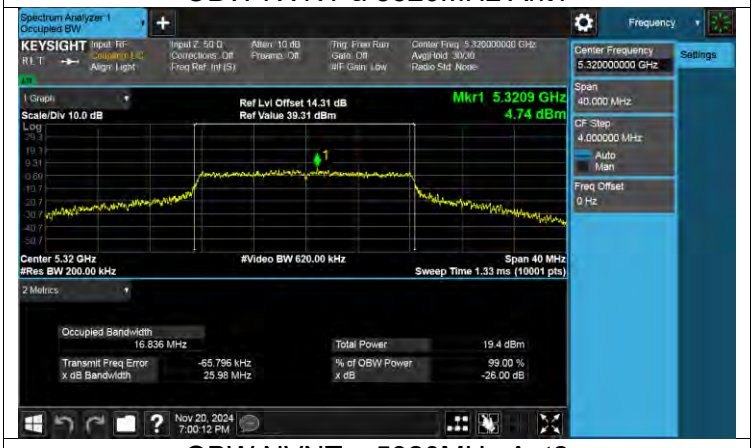

OBW NVNT a 5320MHz Ant2

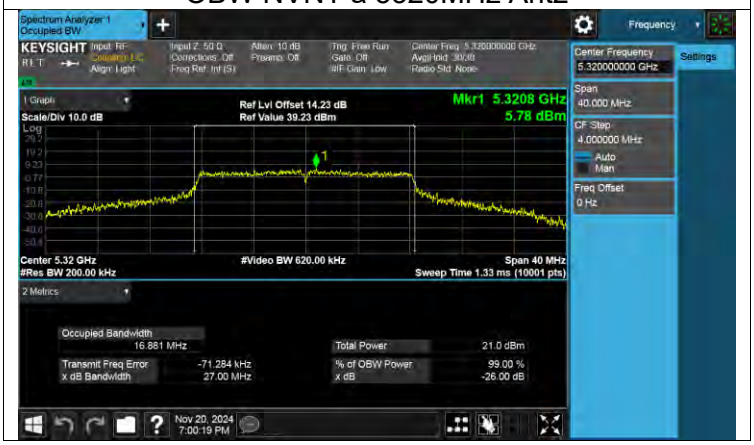

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT a 5500MHz Ant1

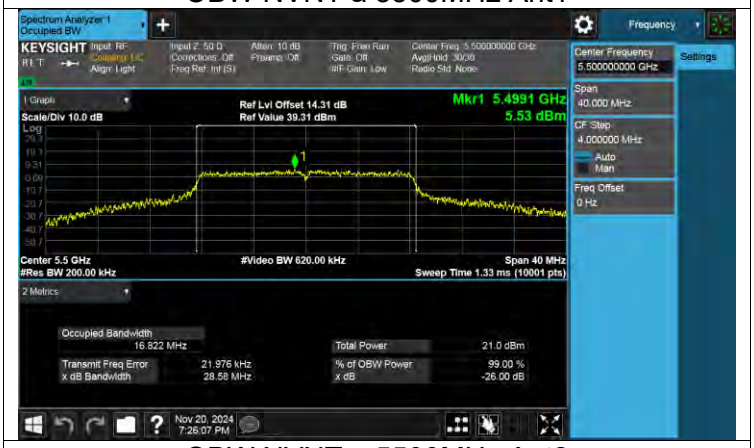

OBW NVNT a 5500MHz Ant2

OBW NVNT a 5580MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT a 5580MHz Ant2

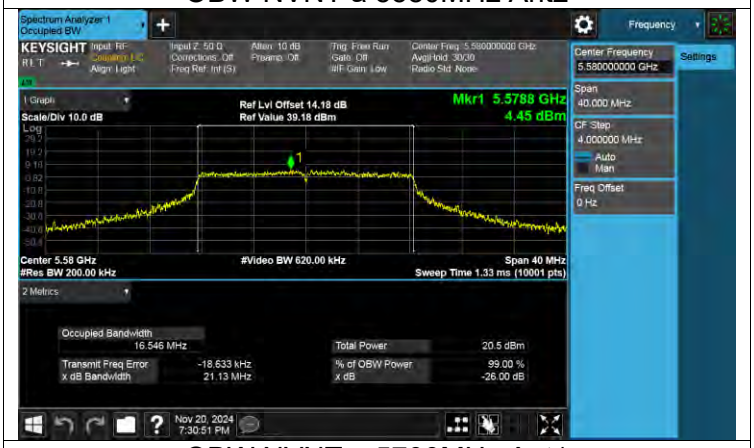

OBW NVNT a 5700MHz Ant1

OBW NVNT a 5700MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT a 5720MHz Ant1

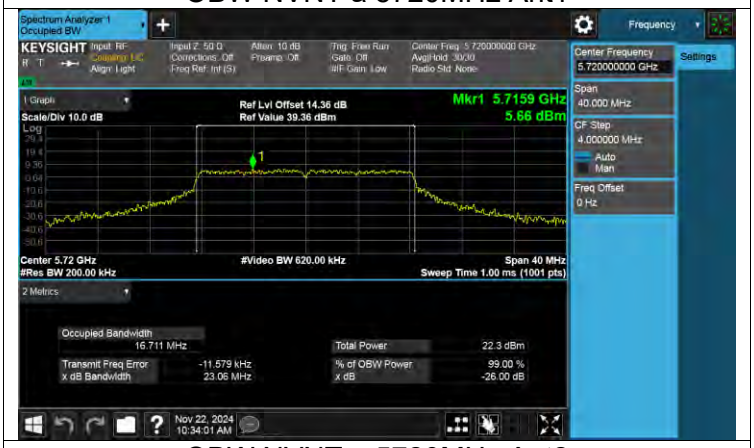

OBW NVNT a 5720MHz Ant2

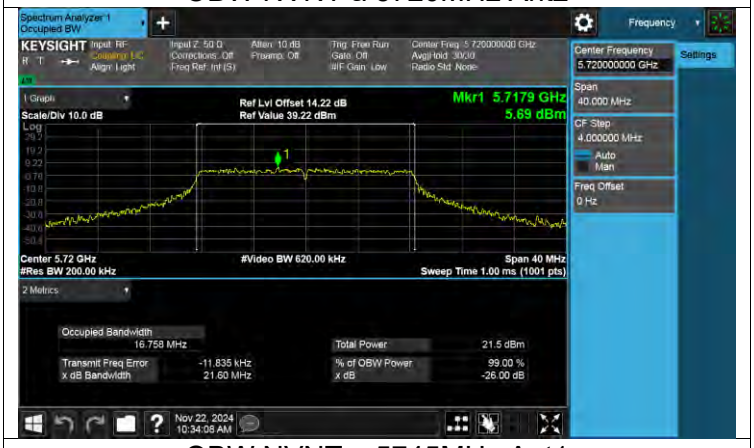

OBW NVNT a 5745MHz Ant1

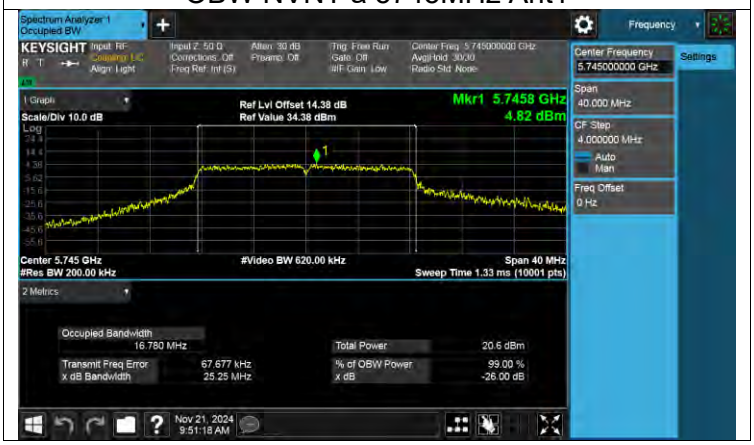

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT a 5745MHz Ant2

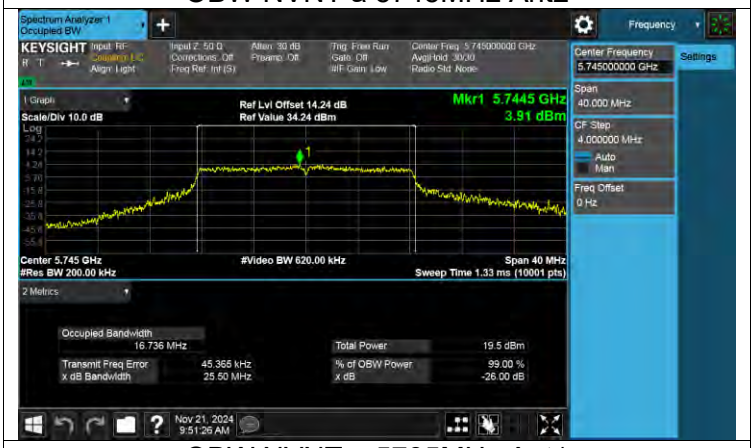

OBW NVNT a 5785MHz Ant1

OBW NVNT a 5785MHz Ant2

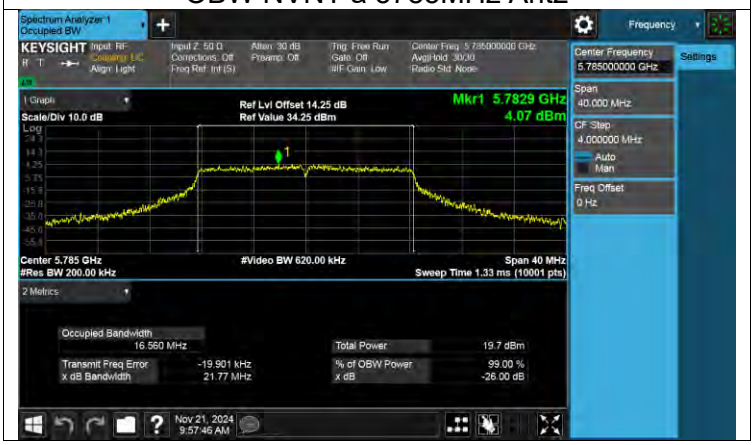

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT a 5825MHz Ant1

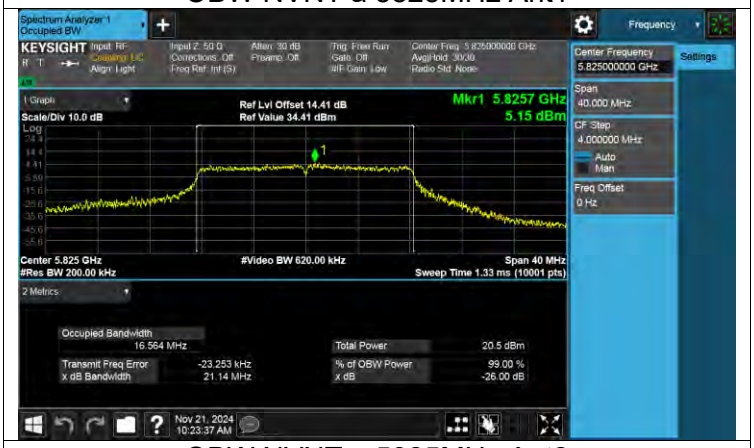

OBW NVNT a 5825MHz Ant2

OBW NVNT n20 5180MHz Ant1

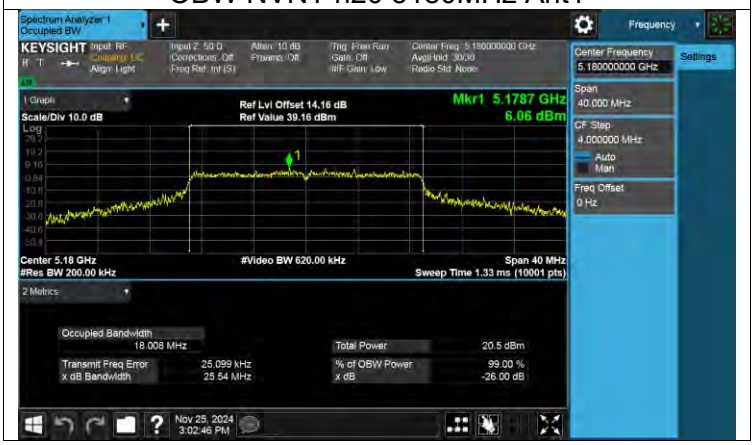

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n20 5180MHz Ant2

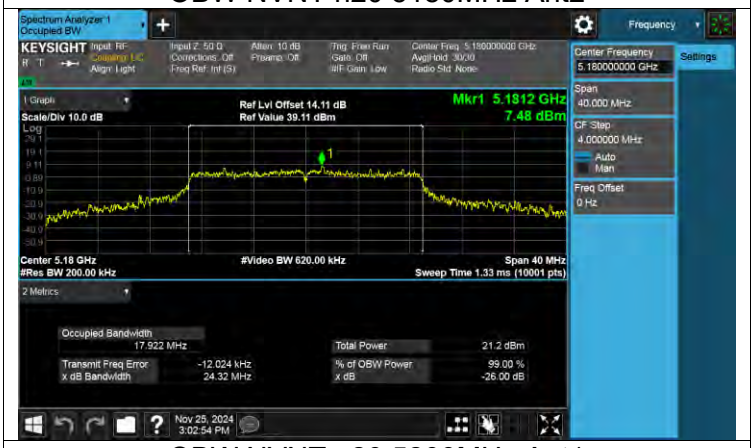

OBW NVNT n20 5200MHz Ant1

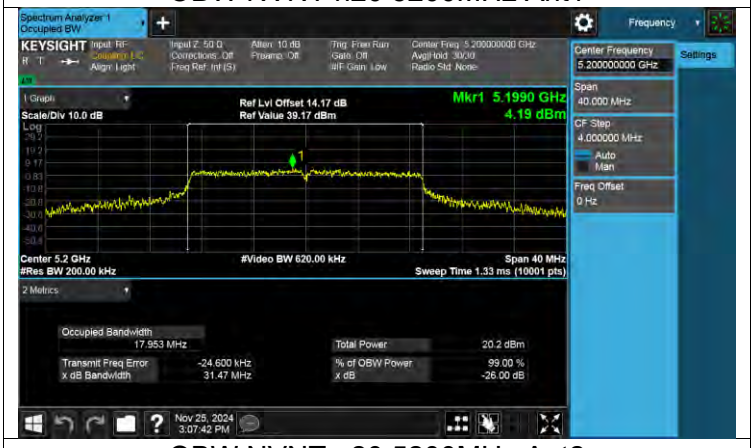

OBW NVNT n20 5200MHz Ant2

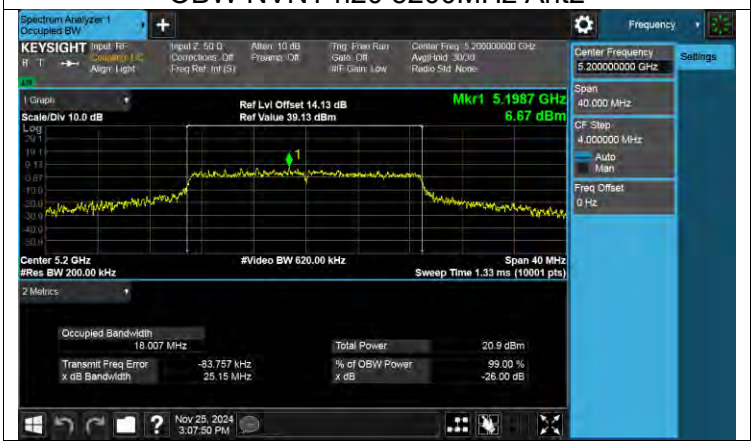

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n20 5240MHz Ant1

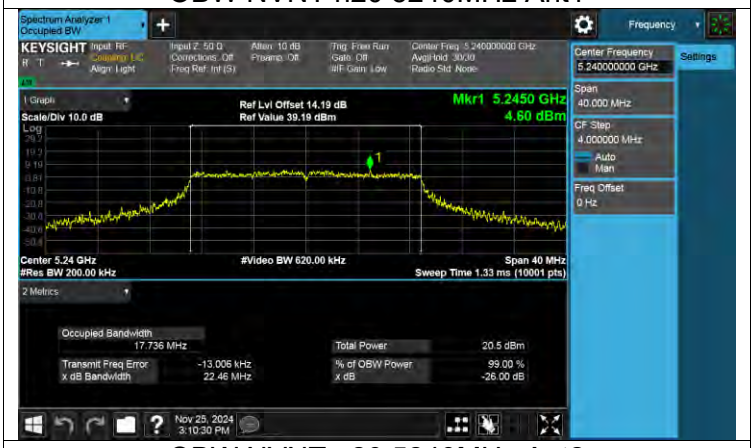

OBW NVNT n20 5240MHz Ant2

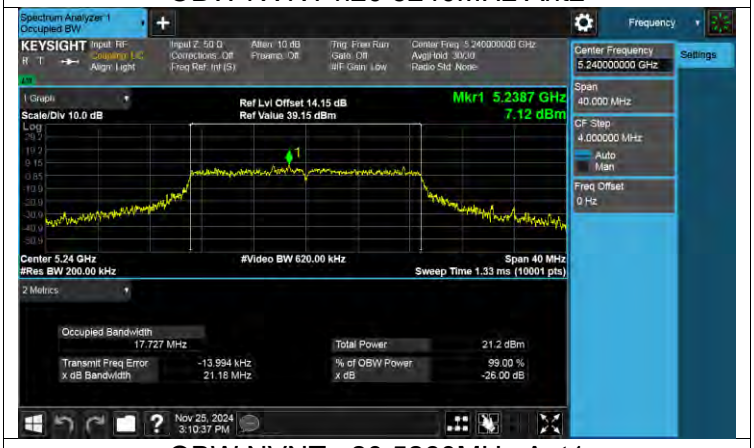

OBW NVNT n20 5260MHz Ant1

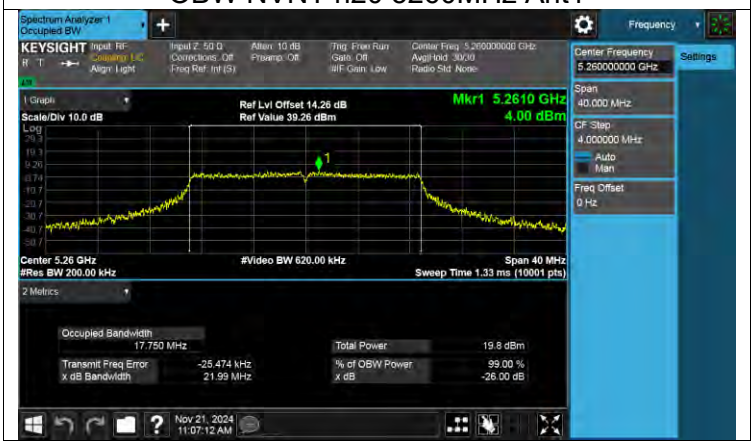

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n20 5260MHz Ant2

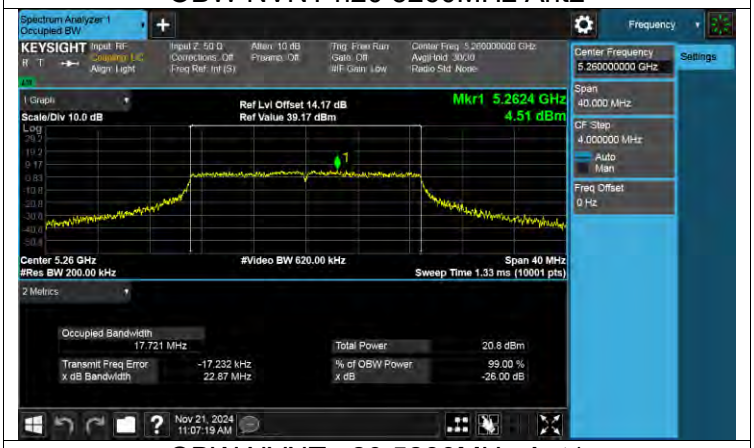

OBW NVNT n20 5280MHz Ant1

OBW NVNT n20 5280MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n20 5320MHz Ant1

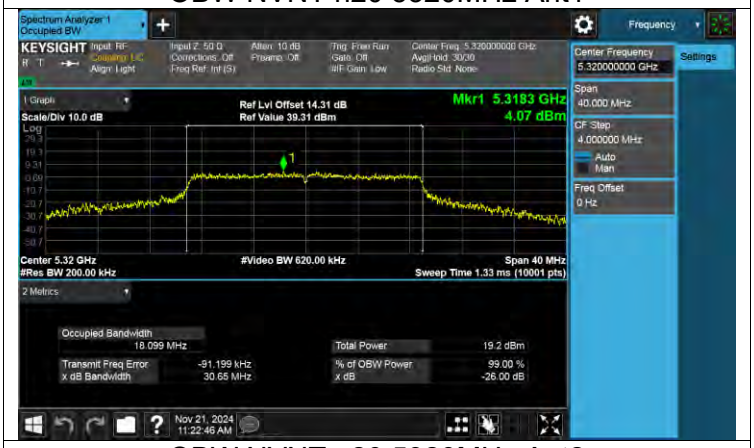

OBW NVNT n20 5320MHz Ant2

OBW NVNT n20 5500MHz Ant1

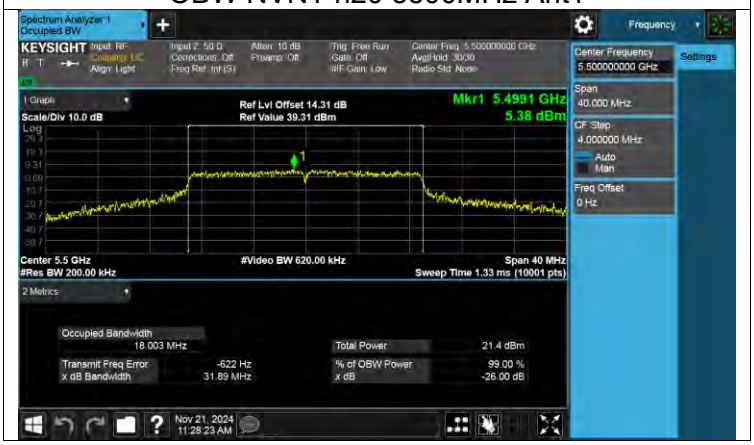

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n20 5500MHz Ant2

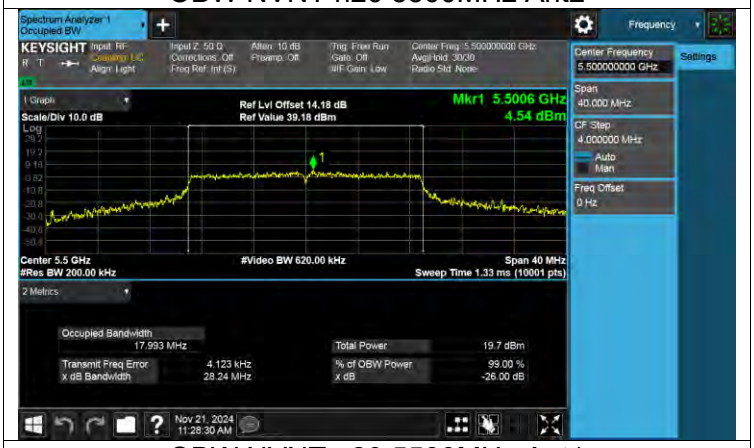

OBW NVNT n20 5580MHz Ant1

OBW NVNT n20 5580MHz Ant2

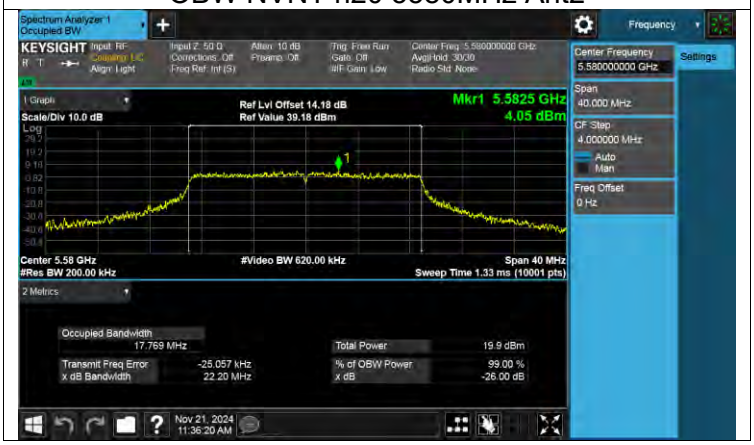

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n20 5700MHz Ant1

OBW NVNT n20 5700MHz Ant2

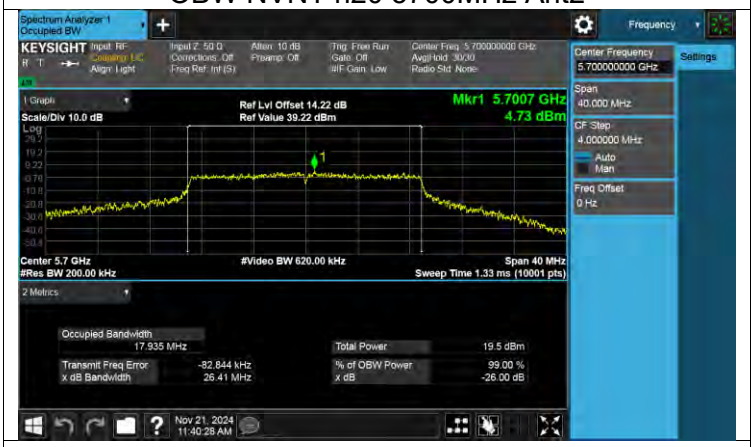

OBW NVNT n20 5720MHz Ant1

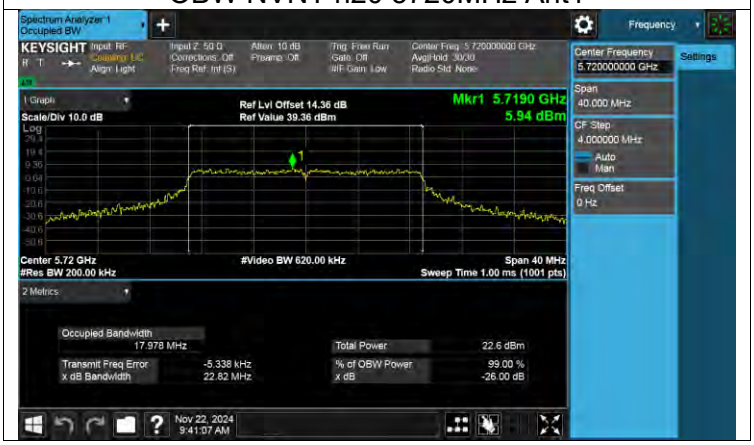

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n20 5720MHz Ant2

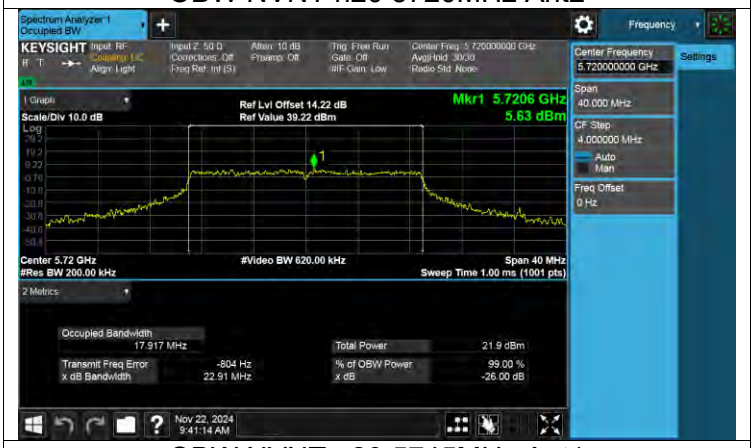

OBW NVNT n20 5745MHz Ant1

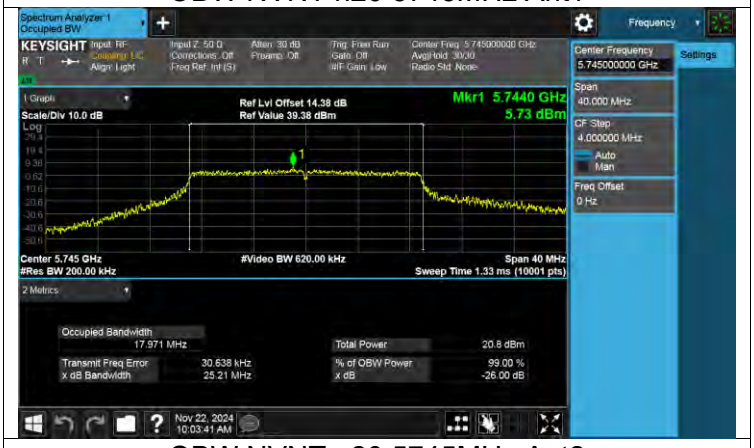

OBW NVNT n20 5745MHz Ant2

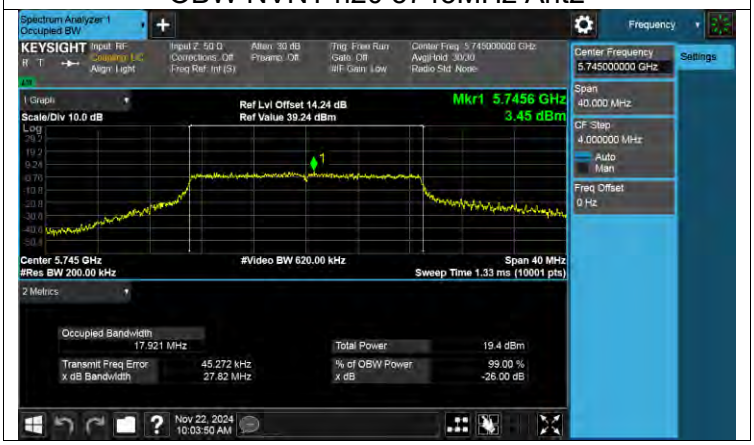

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n20 5785MHz Ant1

OBW NVNT n20 5785MHz Ant2

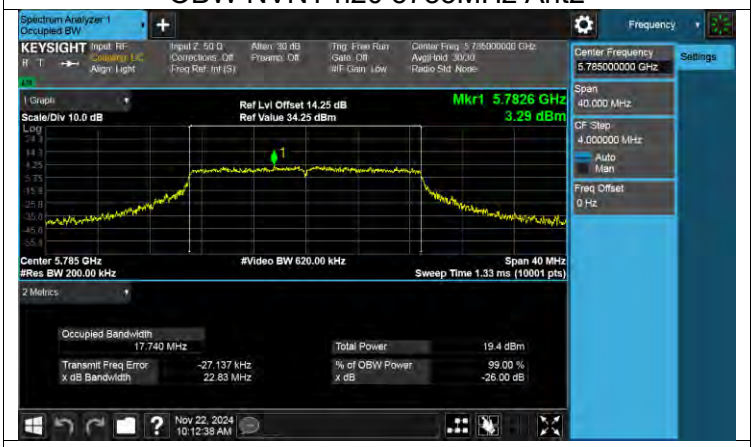

OBW NVNT n20 5825MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n20 5825MHz Ant2

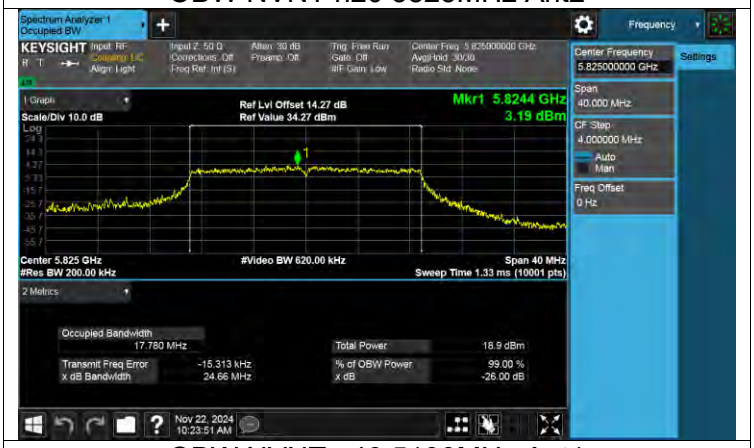

OBW NVNT n40 5190MHz Ant1

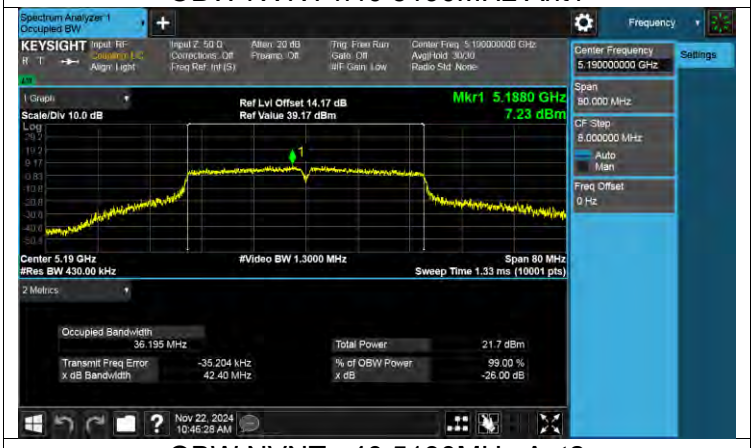

OBW NVNT n40 5190MHz Ant2

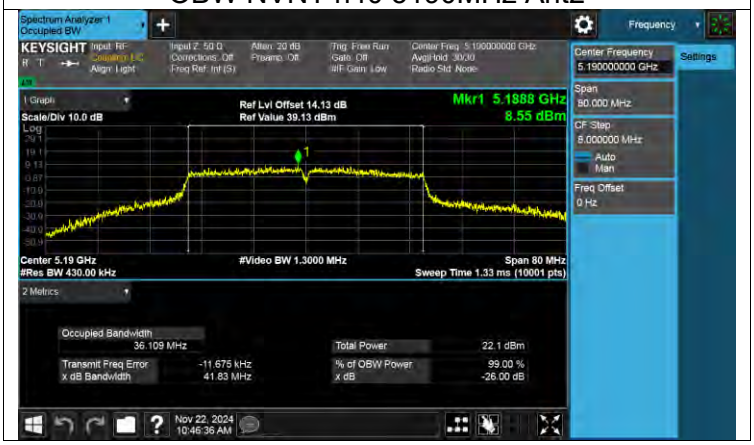

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n40 5230MHz Ant1

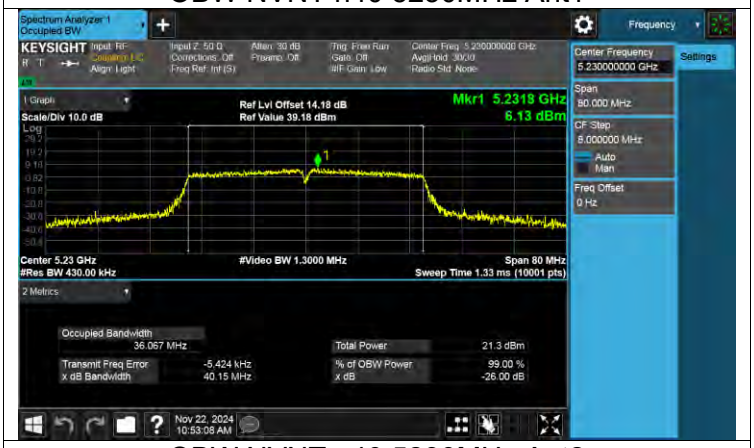

OBW NVNT n40 5230MHz Ant2

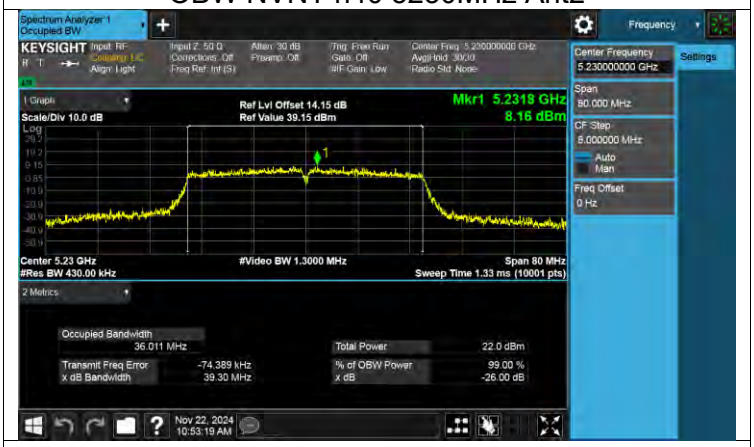

OBW NVNT n40 5270MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n40 5270MHz Ant2

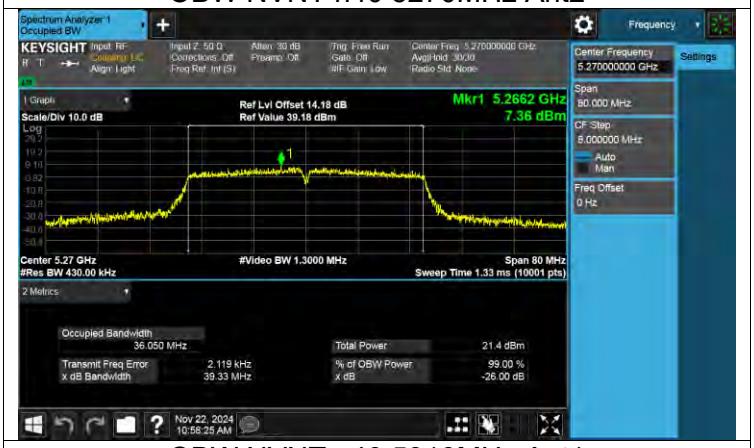

OBW NVNT n40 5310MHz Ant1

OBW NVNT n40 5310MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n40 5510MHz Ant1

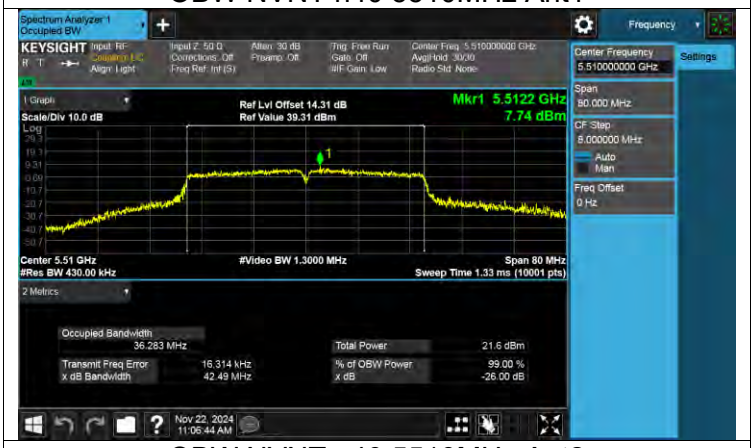

OBW NVNT n40 5510MHz Ant2

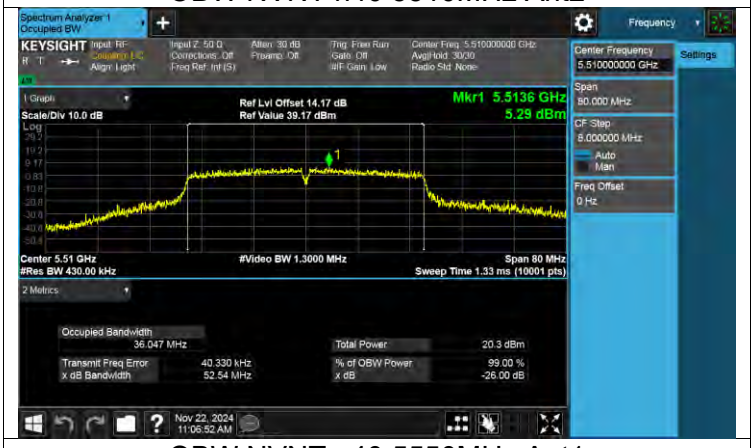

OBW NVNT n40 5550MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n40 5550MHz Ant2

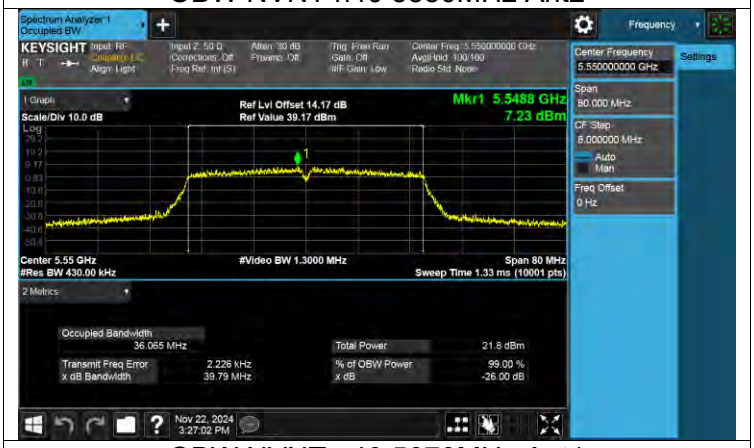

OBW NVNT n40 5670MHz Ant1

OBW NVNT n40 5670MHz Ant2

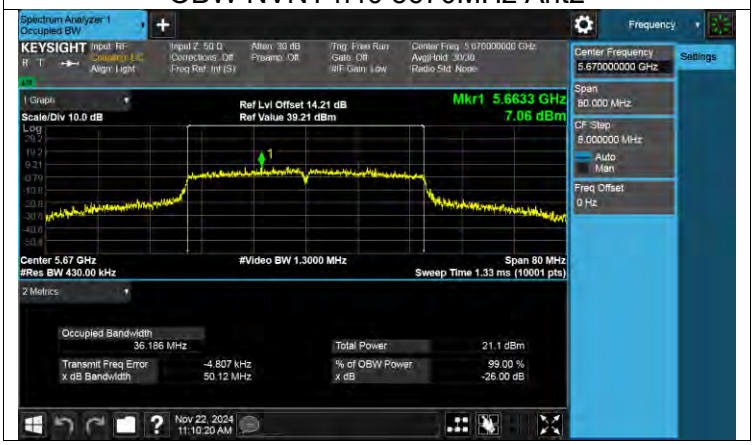

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n40 5710MHz Ant1

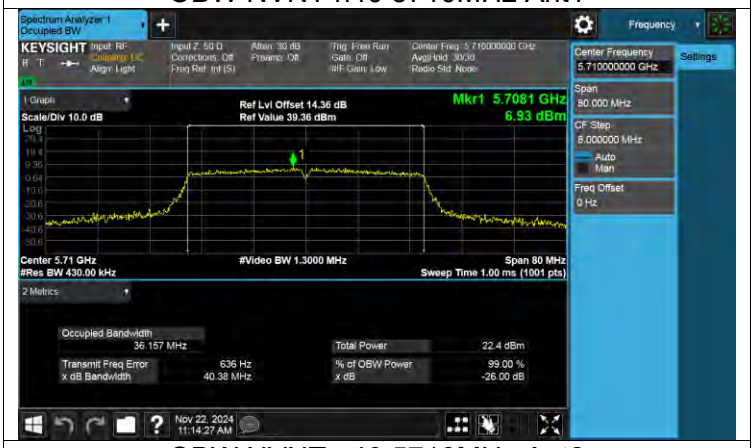

OBW NVNT n40 5710MHz Ant2

OBW NVNT n40 5755MHz Ant1

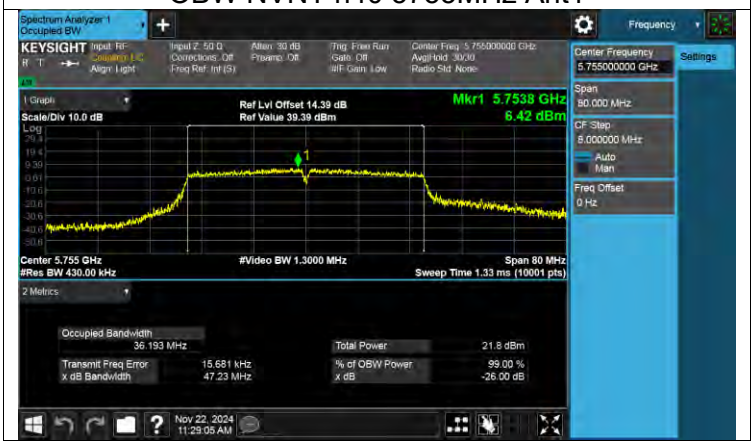

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT n40 5755MHz Ant2

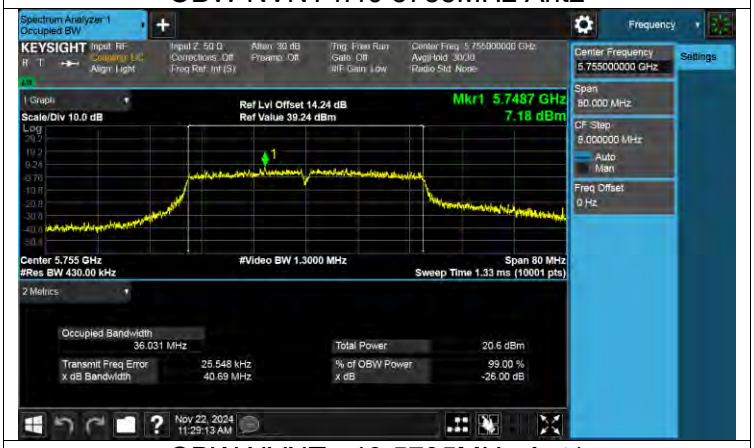

OBW NVNT n40 5795MHz Ant1

OBW NVNT n40 5795MHz Ant2

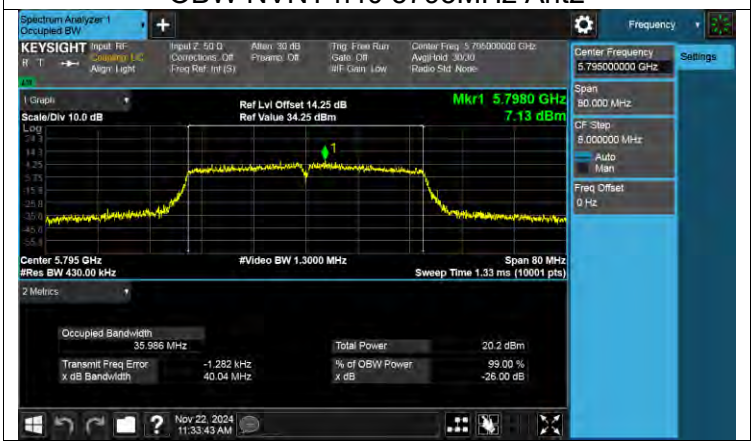

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ac80 5210MHz Ant1

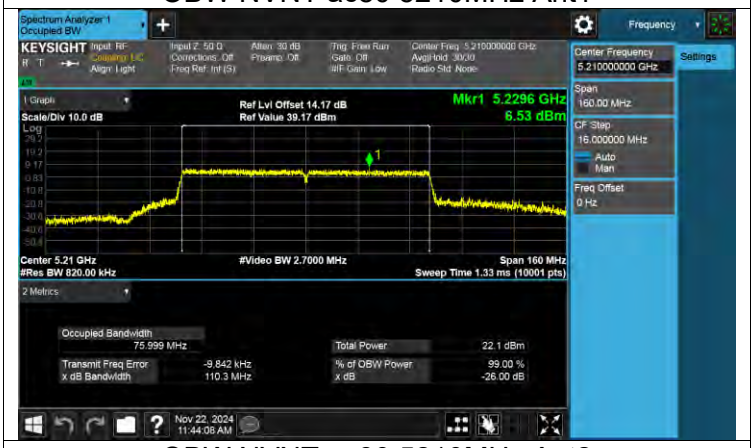

OBW NVNT ac80 5210MHz Ant2

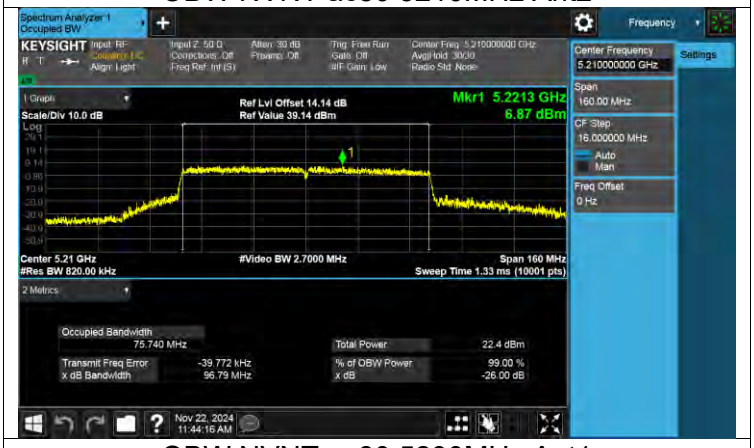

OBW NVNT ac80 5290MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ac80 5290MHz Ant2

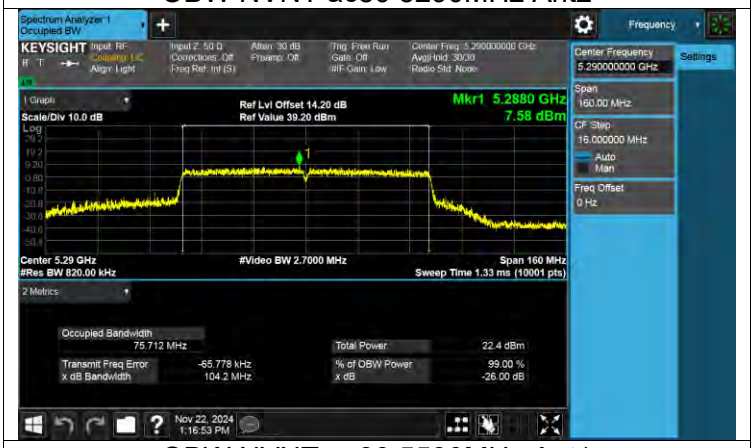

OBW NVNT ac80 5530MHz Ant1

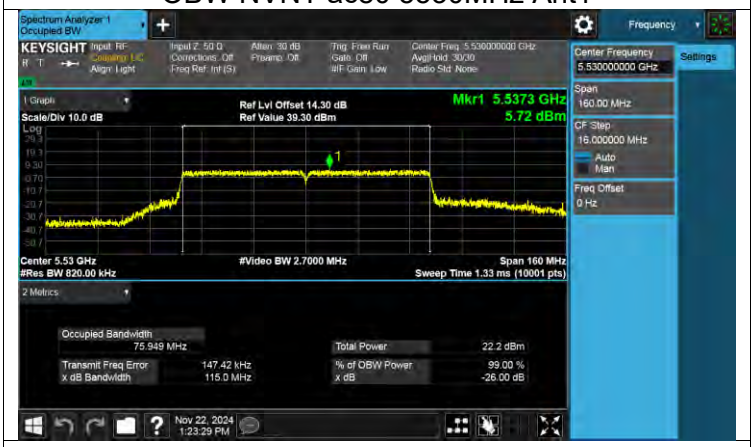

OBW NVNT ac80 5530MHz Ant2

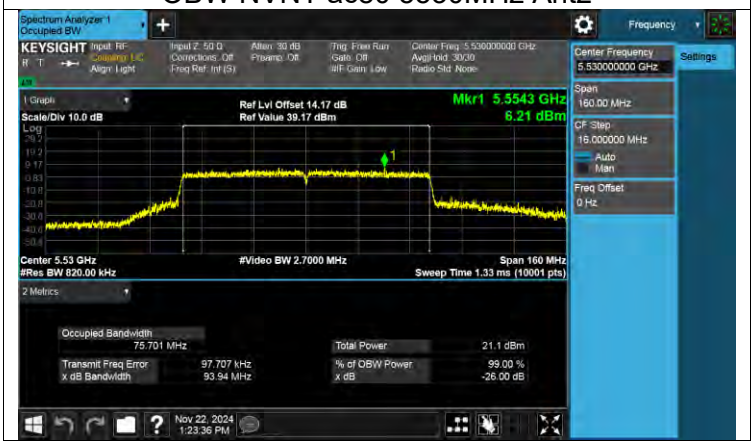

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ac80 5610MHz Ant1

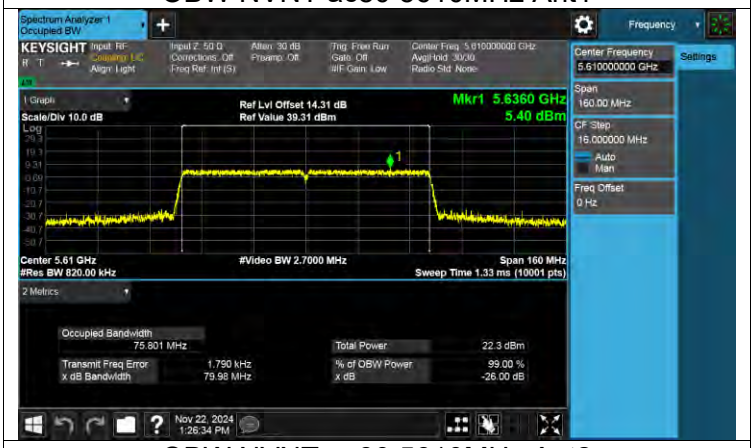

OBW NVNT ac80 5610MHz Ant2

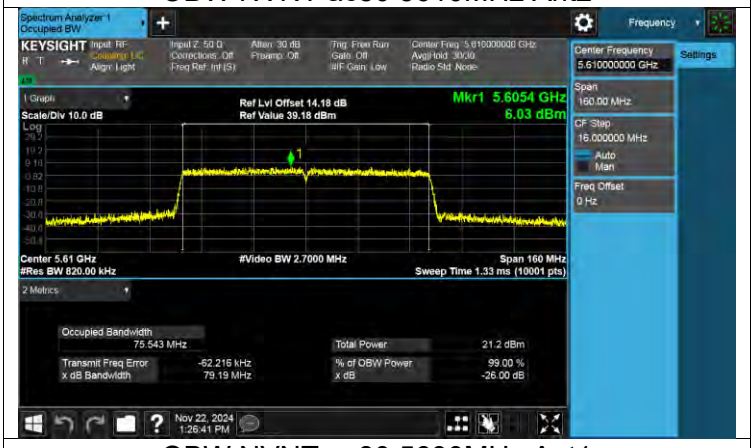

OBW NVNT ac80 5690MHz Ant1

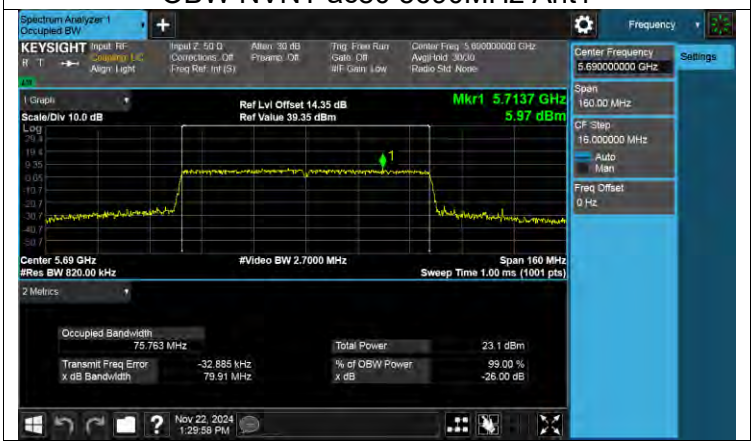

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ac80 5690MHz Ant2

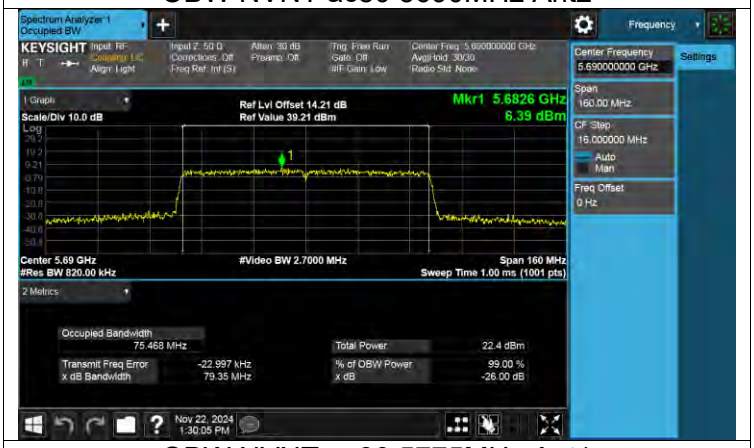

OBW NVNT ac80 5775MHz Ant1

OBW NVNT ac80 5775MHz Ant2

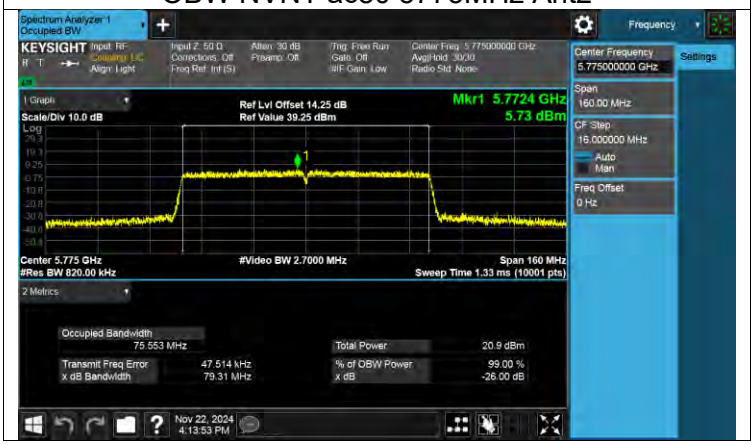

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax20 5180MHz Ant1

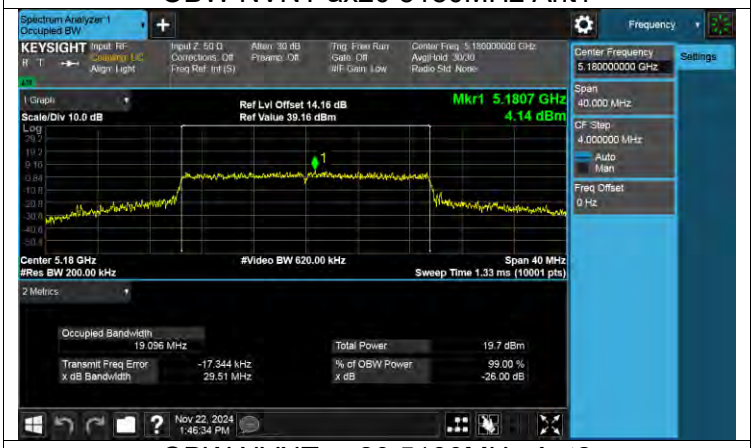

OBW NVNT ax20 5180MHz Ant2

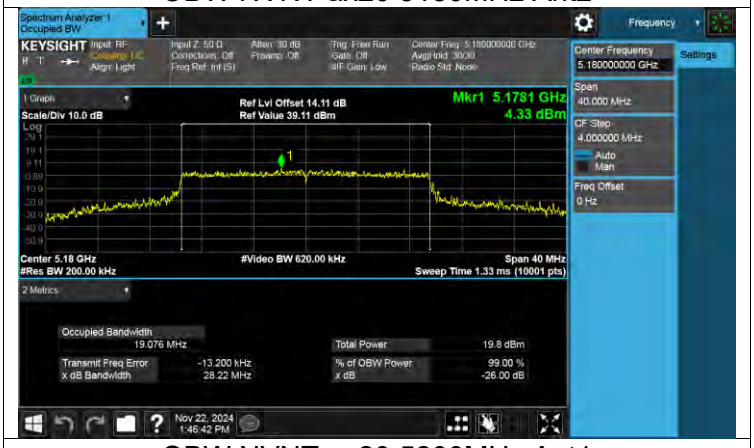

OBW NVNT ax20 5200MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax20 5200MHz Ant2

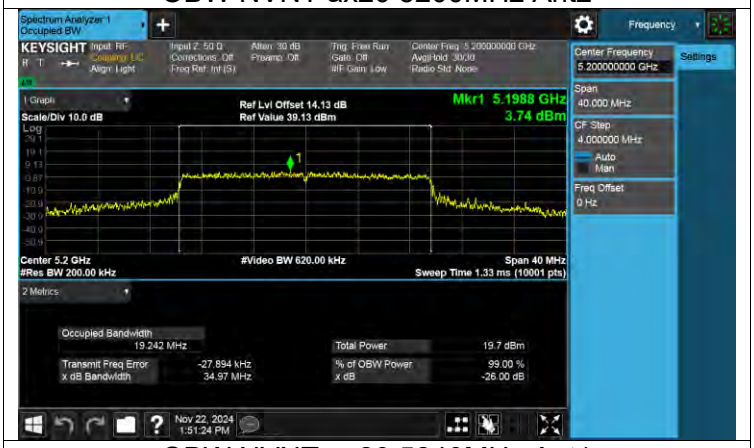

OBW NVNT ax20 5240MHz Ant1

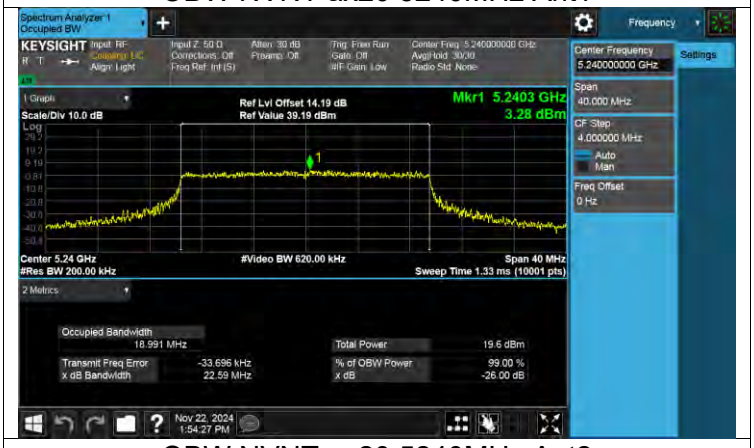

OBW NVNT ax20 5240MHz Ant2

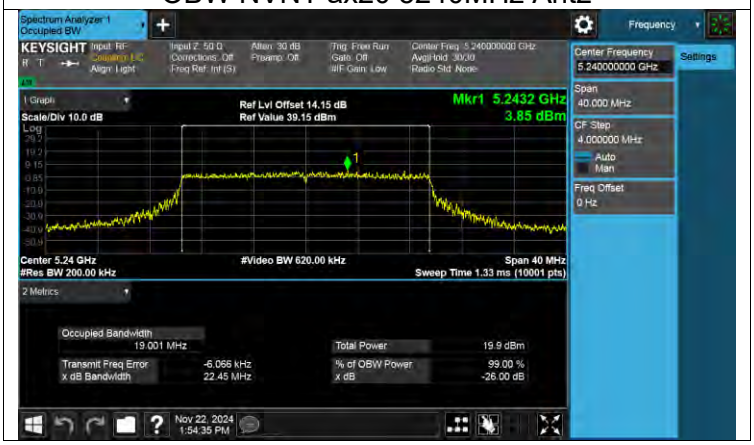

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax20 5260MHz Ant1

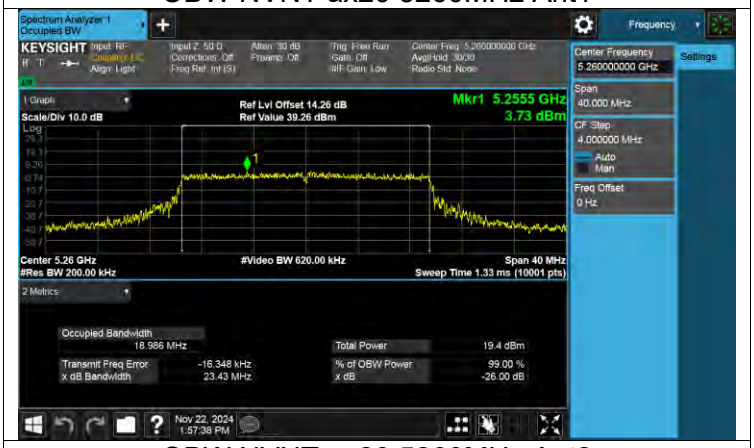

OBW NVNT ax20 5260MHz Ant2

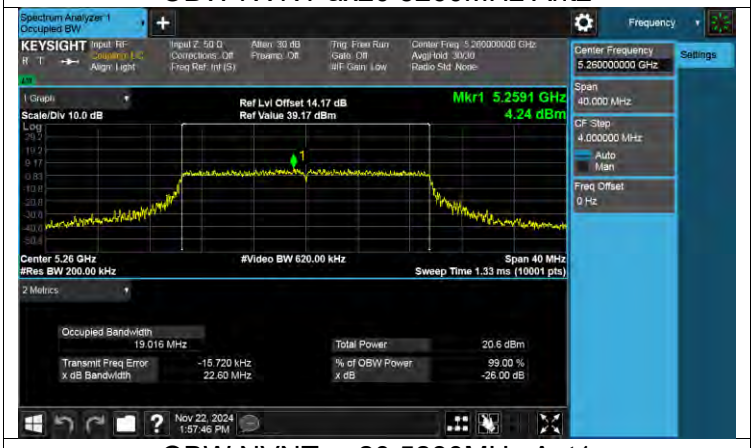

OBW NVNT ax20 5280MHz Ant1

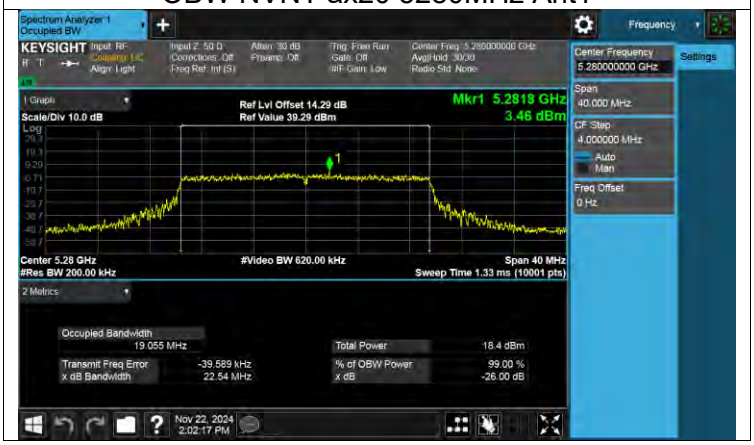

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax20 5280MHz Ant2

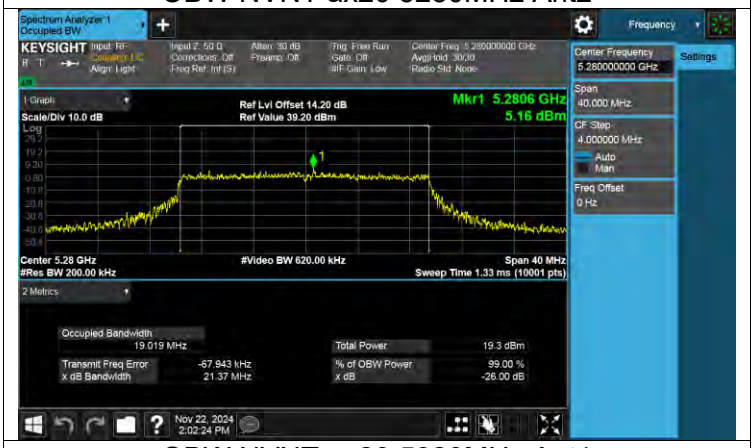

OBW NVNT ax20 5320MHz Ant1

OBW NVNT ax20 5320MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax20 5500MHz Ant1

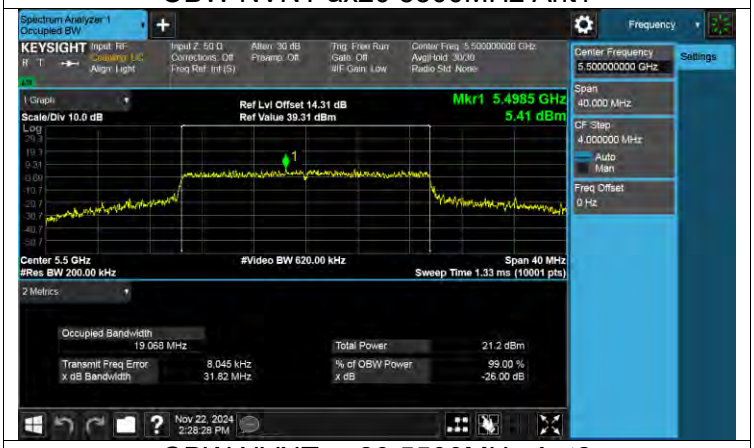

OBW NVNT ax20 5500MHz Ant2

OBW NVNT ax20 5580MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax20 5580MHz Ant2

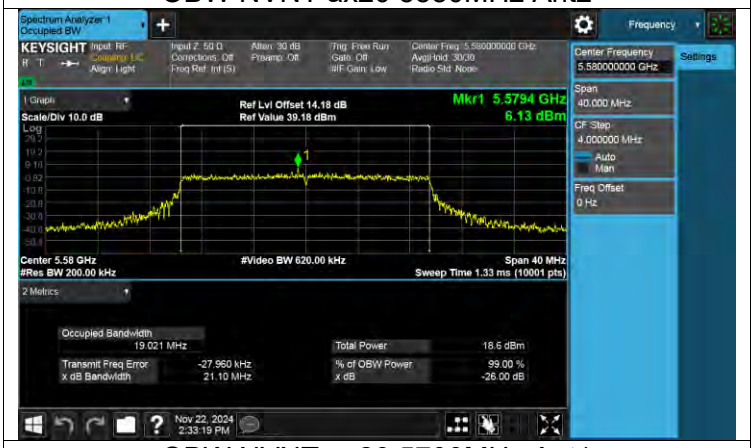

OBW NVNT ax20 5700MHz Ant1

OBW NVNT ax20 5700MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax20 5720MHz Ant1

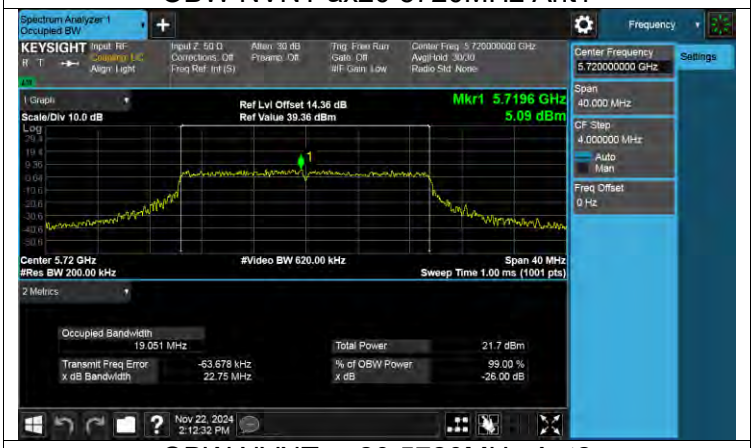

OBW NVNT ax20 5720MHz Ant2

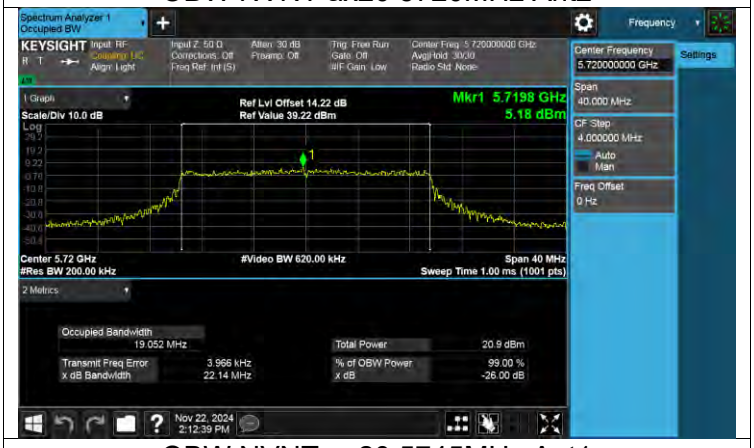

OBW NVNT ax20 5745MHz Ant1

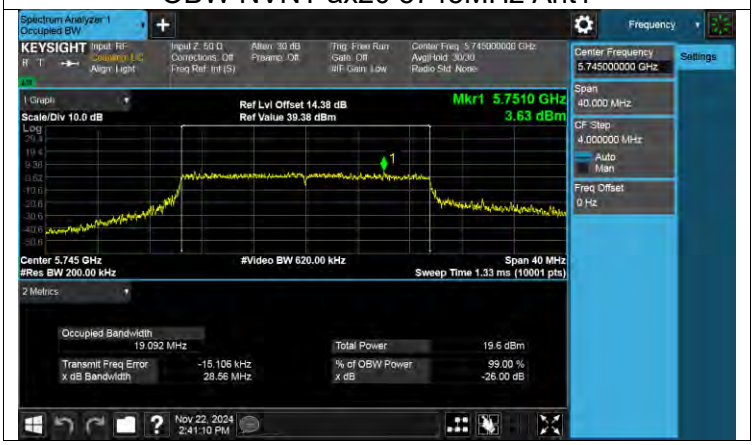

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax20 5745MHz Ant2

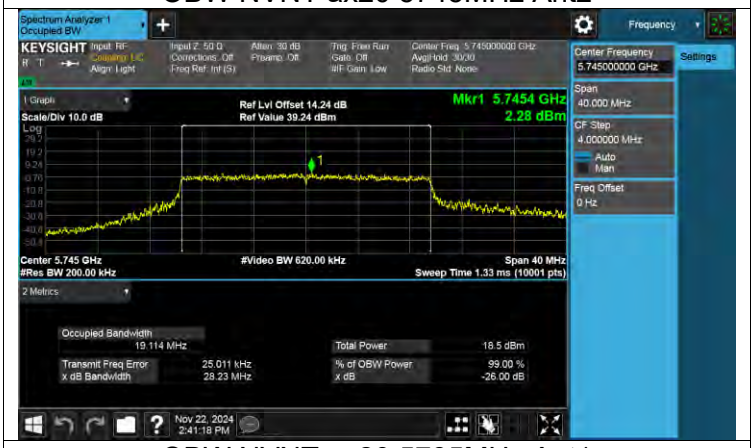

OBW NVNT ax20 5785MHz Ant1

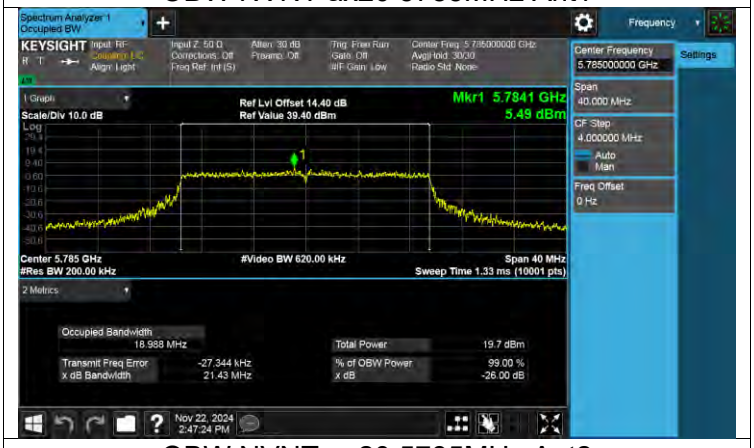

OBW NVNT ax20 5785MHz Ant2

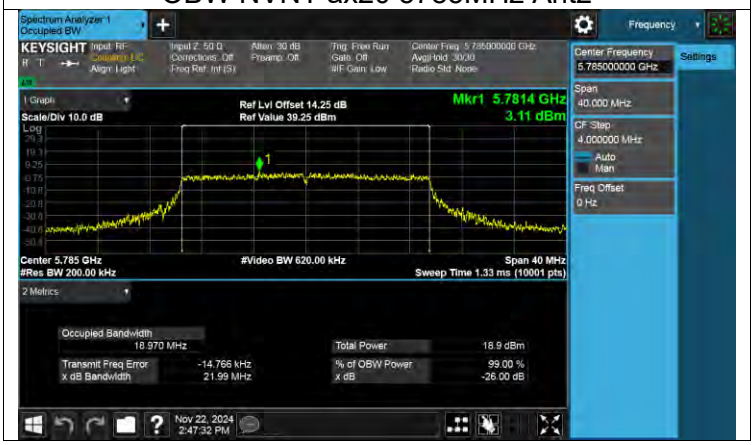

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax20 5825MHz Ant1

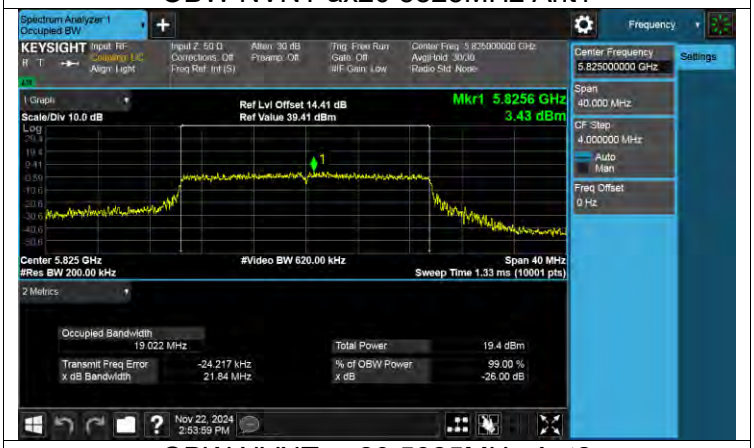

OBW NVNT ax20 5825MHz Ant2

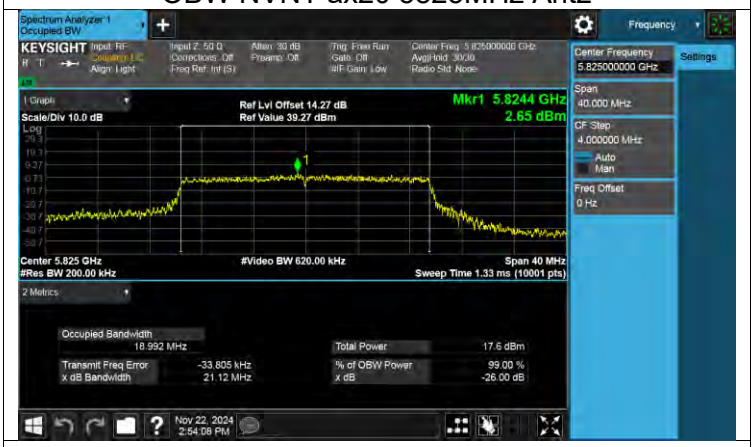

OBW NVNT ax40 5190MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax40 5190MHz Ant2

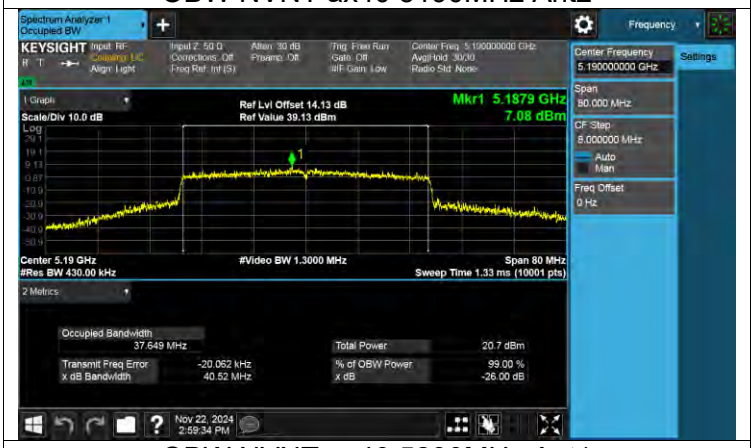

OBW NVNT ax40 5230MHz Ant1

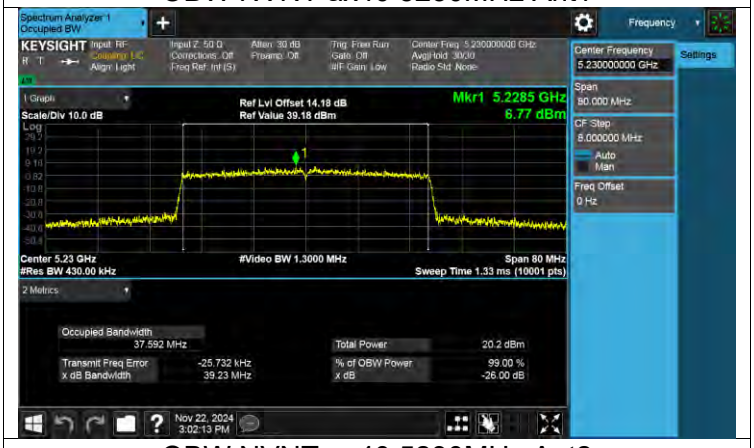

OBW NVNT ax40 5230MHz Ant2

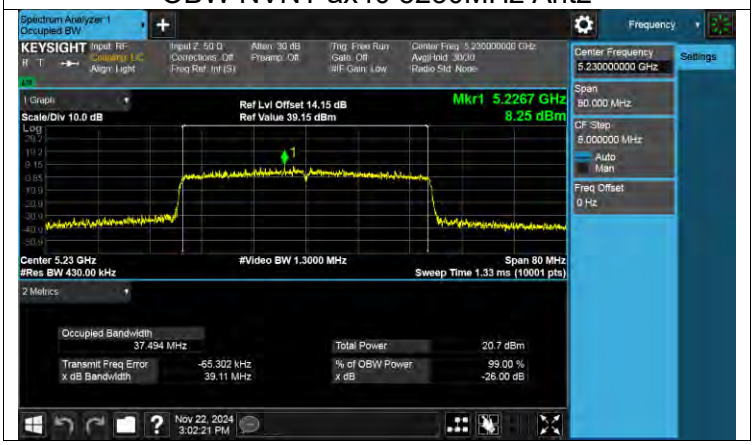

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax40 5270MHz Ant1

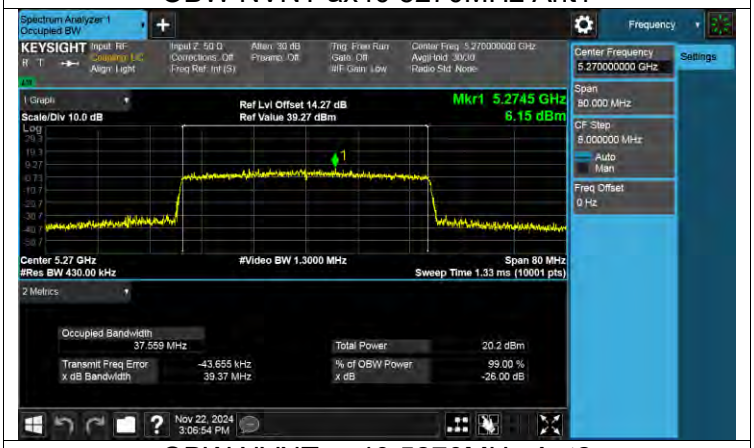

OBW NVNT ax40 5270MHz Ant2

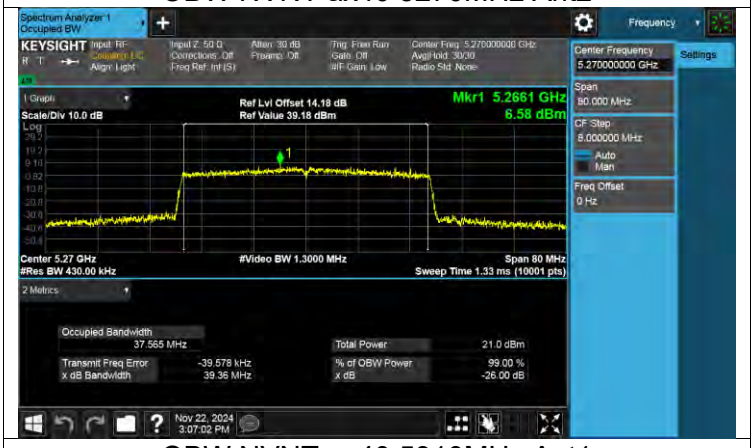

OBW NVNT ax40 5310MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax40 5310MHz Ant2

OBW NVNT ax40 5510MHz Ant1

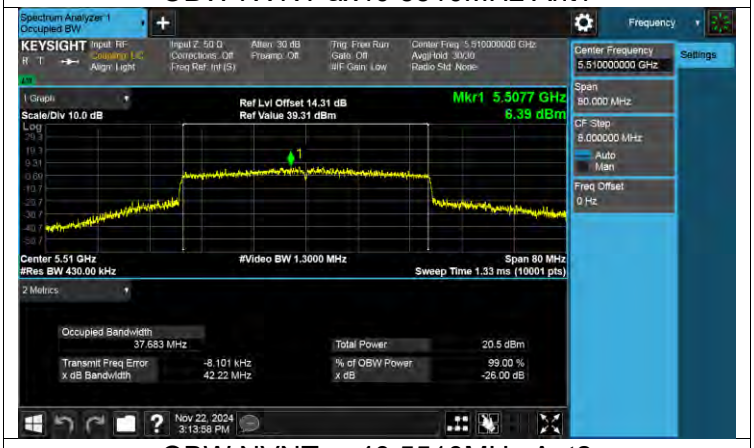

OBW NVNT ax40 5510MHz Ant2

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax40 5550MHz Ant1

OBW NVNT ax40 5550MHz Ant2

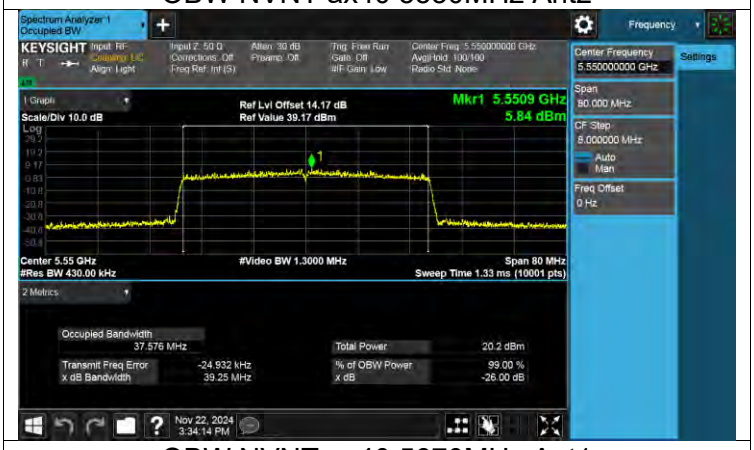

OBW NVNT ax40 5670MHz Ant1

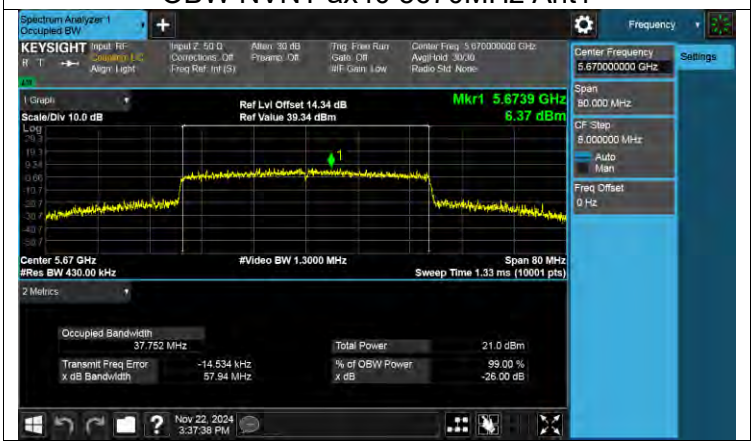

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax40 5670MHz Ant2

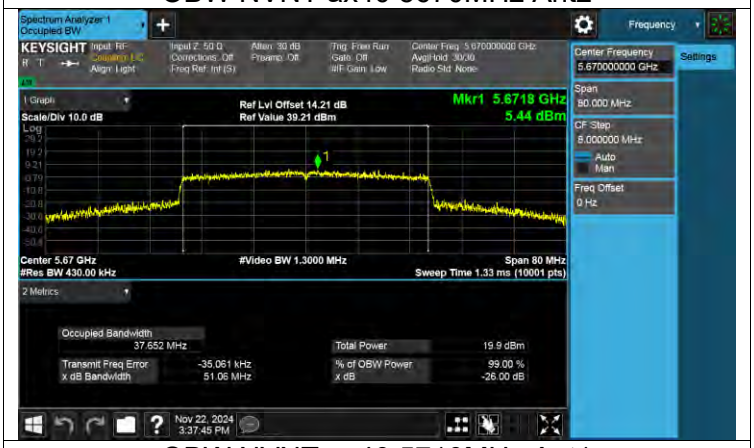

OBW NVNT ax40 5710MHz Ant1

OBW NVNT ax40 5710MHz Ant2

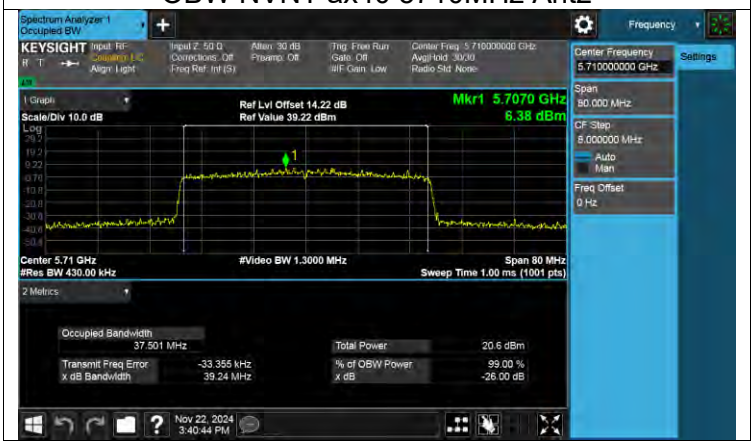

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax40 5755MHz Ant1

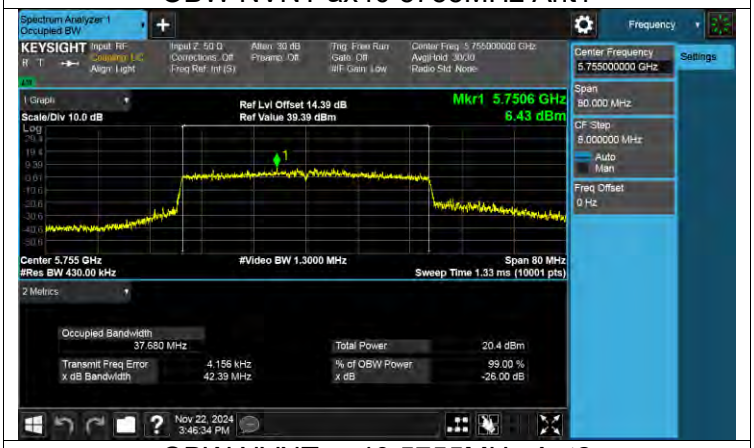

OBW NVNT ax40 5755MHz Ant2

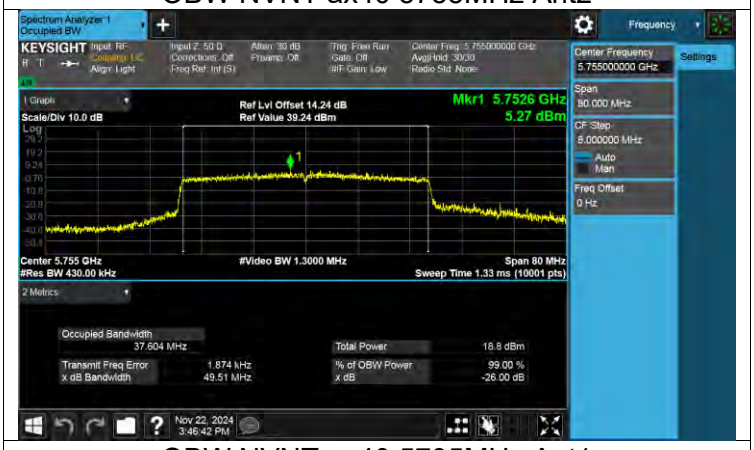

OBW NVNT ax40 5795MHz Ant1

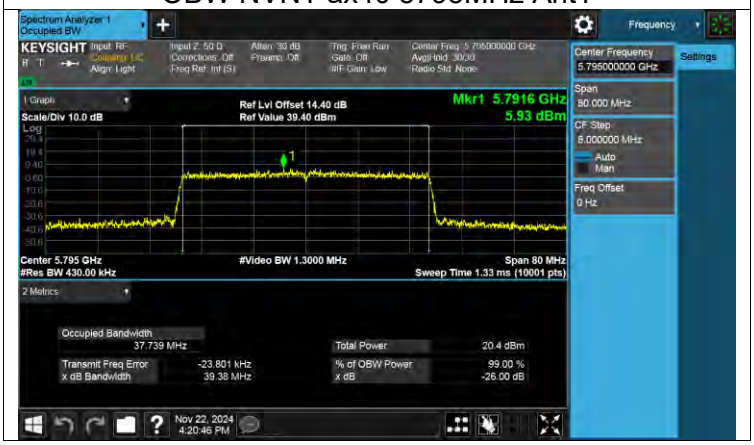

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax40 5795MHz Ant2

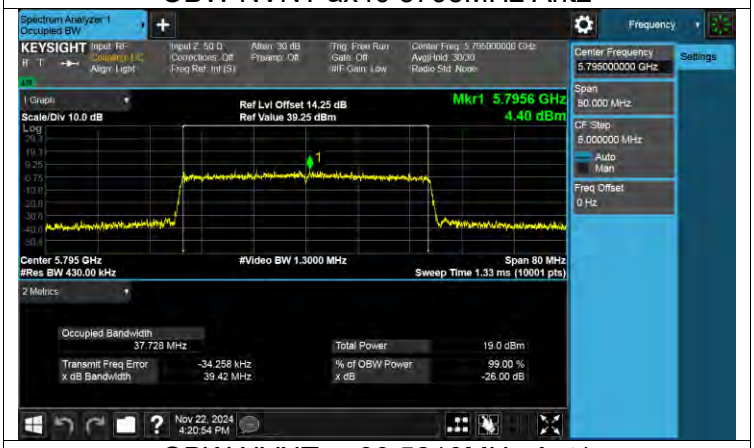

OBW NVNT ax80 5210MHz Ant1

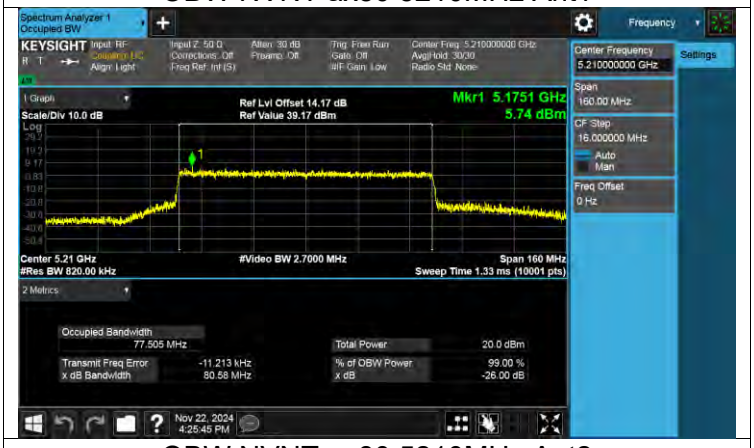

OBW NVNT ax80 5210MHz Ant2

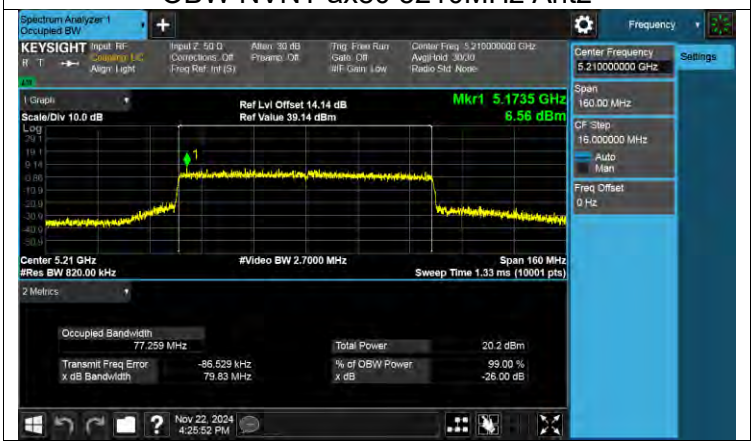

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

OBW NVNT ax80 5290MHz Ant1

OBW NVNT ax80 5290MHz Ant2

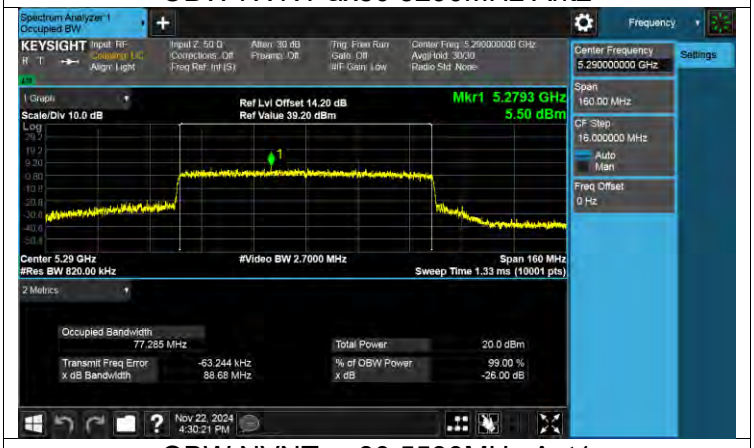

OBW NVNT ax80 5530MHz Ant1

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.