



Intertek Testing Services

ETL SEMKO

Report No.: 9810675

Tested By: Hong, Report No.: 9810675

Scan Settings (1 Range)

Frequencies		Receiver Settings						
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Presamp	OpRge
450k	30M	5k	10k	PK	Cons	AUTO	LN OFF	60dB

Final Measurement: N OP


Meas Time: 1 s

Subranges: 16

Acc Margin: 20dB

Transducer No.	Start	Stop	Name
3	9k	30M	21078

dBuV

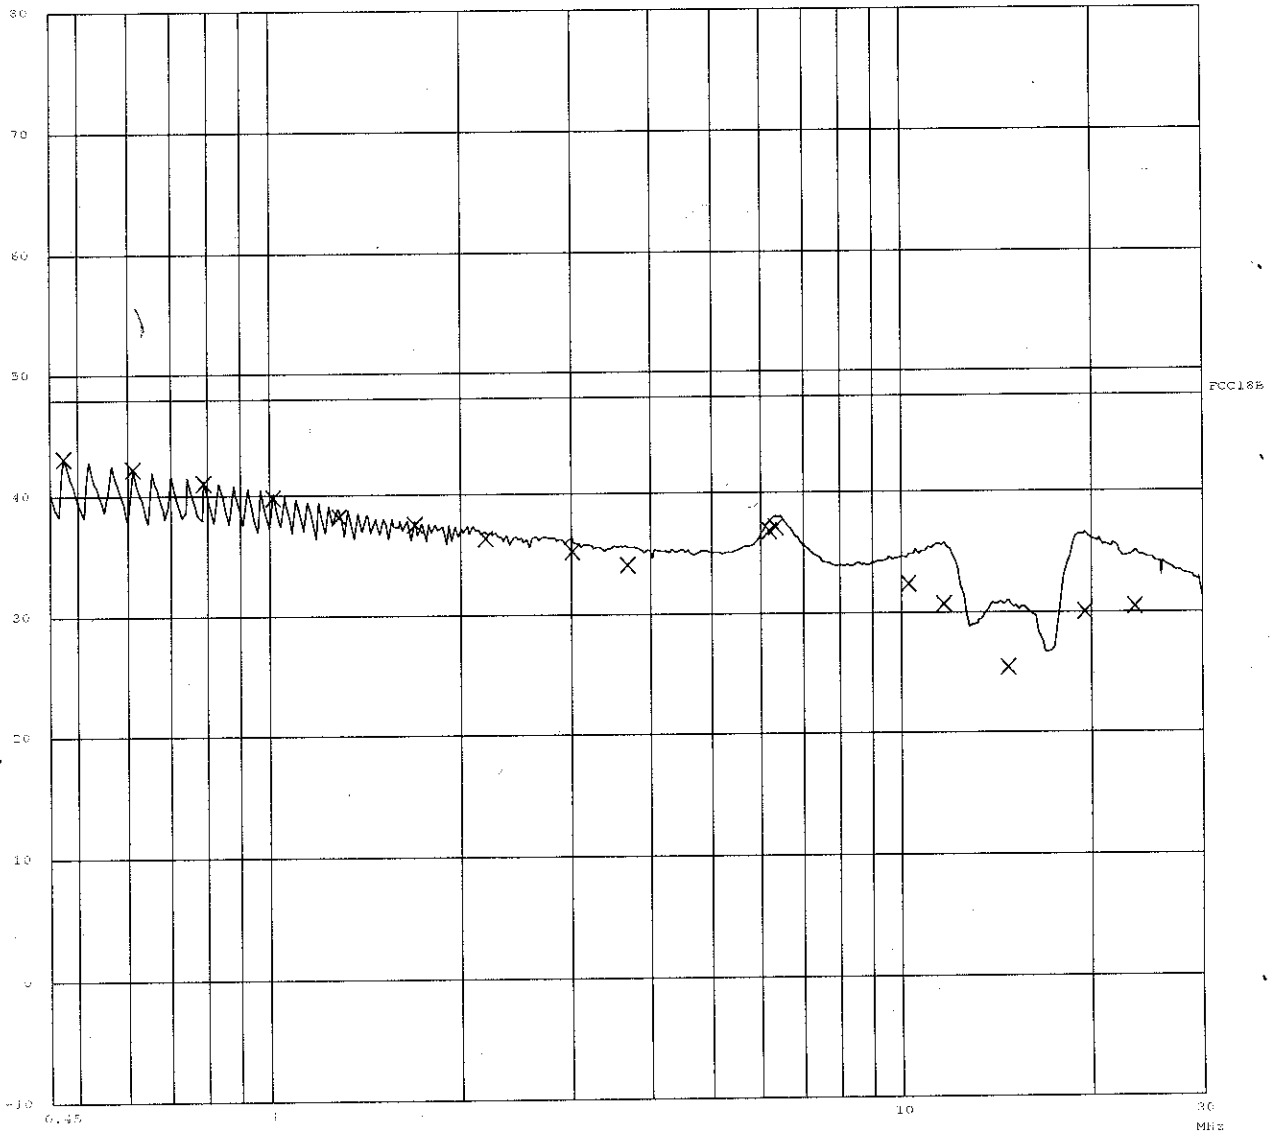

Ctrl. No.: N/A

FCC ID: IPAQE704



Intertek Testing Services

ETL SEMKO

Report No.: 9810675

Tested By: Hong, Report No.: 9810675

Scan Settings (1 Range)

Frequencies			Receiver Settings					
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF	60dB

Final Measurement Results:

Frequency MHz	QP Level dBuV	QP Limit dBuV
0.47500	43.0	48.0
0.61000	42.2	48.0
0.79000	41.0	48.0
1.01500	39.8	48.0
1.29000	38.1	48.0
1.69500	37.5	48.0
2.19000	36.3	48.0
3.00500	35.2	48.0
3.68500	34.1	48.0
6.18000	36.7	48.0
6.32000	37.1	48.0
10.30000	32.3	48.0
11.71000	30.6	48.0
14.77000	25.4	48.0
19.52000	30.0	48.0
23.50500	30.4	48.0

* limit exceeded

Ctrl. No.: N/A

FCC ID: IPAQE704