

AFC DUT TEST HARNESS REPORT

FCC ID : LDK-9160S2579

Equipment : Catalyst Wireless 9166D1 Series Wi-Fi 6E Access Point

Brand Name : CISCO

Model Name : CW9166D1-B, CW9166D1-MR


Applicant : Cisco Systems Inc
125 West Tasman Drive San Jose California United
States 95134-1706

Manufacturer : Cisco Systems Inc
125 West Tasman Drive San Jose California United
States 95134-1706

Standard : 47 CFR FCC Part 15.407

The product was received on Sep. 13, 2023, and testing was started from Sep. 13, 2023 and completed on Oct. 04, 2023. We, Sporton International Inc. Hsinchu Laboratory, would like to declare that the tested sample has been evaluated in accordance with the procedures given in AFC Device (AFC DUT) Compliance Test Plan Version 1.5 and shown compliance with the applicable technical standards.

The test results in this variant report apply exclusively to the tested model / sample. Without written approval of Sporton International Inc. Hsinchu Laboratory, the test report shall not be reproduced except in full.

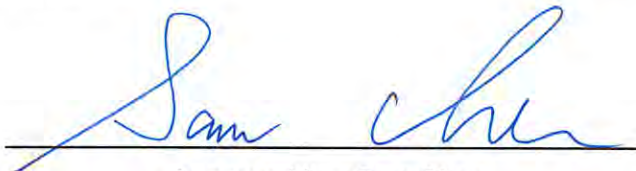

Approved by: Sam Chen

Sporton International Inc. Hsinchu Laboratory

No.8, Ln. 724, Bo'ai St., Zhubei City, Hsinchu County 302010, Taiwan (R.O.C.)



Table of Contents

1	General Description	6
1.1	Product Feature of Equipment Under Test	6
1.2	Table for Multiple Listing	7
1.3	Table for Radio function	7
1.4	Table for EUT Operation Function	8
1.5	Accessories	8
1.6	Table for Permissive Change	9
1.7	Support Equipment	9
1.8	Applicable Standards	10
1.9	Testing Location	10
2	Measurement Environment	11
2.1	AFCD General Capabilities Declaration	11
2.2	Test Configuration	12
3	Protocol Test Results	14
3.1	Successful Registration and Spectrum Access Request	14
3.2	Unsuccessful Spectrum Access Request	16
3.3	Successful Spectrum Access Update	17
3.4	Unsuccessful Spectrum Access Update	19
3.5	Unsuccessful Server Validation	21
4	Test Equipment and Calibration Data	22
5	Measurement Uncertainty	23

Appendix A. Tools Report

Appendix B. DUT Spectrum Inquiry Request/Response Logs

Appendix C. RF Measurement Plots

Photographs of EUT v01



Summary of Test Result

Report Clause	Ref Std. Clause	Test Case Name	Result (PASS/FAIL)	Remark
AFC capability - Inquired Frequency				
Test Group: Inquired Frequency - Always				
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_Frequency_20MHz_10611_1	PASS	Meraki SW only
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_Frequency_40MHz_10612_1	PASS	Meraki SW only
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_Frequency_80MHz_10613_1	PASS	Meraki SW only
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_Frequency_160MHz_10614_1	PASS	Meraki SW only
3.2	3.2.4	CT_AFC_SP_AP_AFCDUSA32_Frequency_10615_1	PASS	Meraki SW only
3.3	3.3.4	CT_AFC_SP_AP_AFCDSAU33_Frequency_10616_1	PASS	Meraki SW only
3.4	3.4.4	CT_AFC_SP_AP_AFCDUAU34_Frequency_10617_1	PASS	Meraki SW only
AFC capability - Inquired Channel				
Test Group: Inquired Channel - Always				
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_Channel_20MHz_10618_1	PASS	Cisco SW only
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_Channel_40MHz_10619_1	PASS	Cisco SW only
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_Channel_80MHz_10620_1	PASS	Cisco SW only
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_Channel_160MHz_10621_1	PASS	Cisco SW only
3.2	3.2.4	CT_AFC_SP_AP_AFCDUSA32_Channel_10622_1	PASS	Cisco SW only
3.3	3.3.4	CT_AFC_SP_AP_AFCDSAU33_Channel_10623_1	PASS	Cisco SW only
3.4	3.4.4	CT_AFC_SP_AP_AFCDUAU34_Channel_10624_1	PASS	Cisco SW only
AFC capability - Inquired Frequency & Channel				
Test Group: Inquired Frequency and Channel - Always				
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_FrequencyChannel_20MHz_10625_1	N/A	-
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_FrequencyChannel_40MHz_10626_1	N/A	-
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_FrequencyChannel_80MHz_10627_1	N/A	-
3.1	3.1.4	CT_AFC_SP_AP_AFCDRSA31_FrequencyChannel_160MHz_10628_1	N/A	-
3.2	3.2.4	CT_AFC_SP_AP_AFCDUSA32_FrequencyChannel_10629_1	N/A	-
3.3	3.3.4	CT_AFC_SP_AP_AFCDSAU33_FrequencyChannel_10630_1	N/A	-
3.4	3.4.4	CT_AFC_SP_AP_AFCDUAU34_FrequencyChannel_10631_1	N/A	-
AFC capability - Server Validation – Mandatory				
Test Group: Server Validation - Always				
3.5	3.5.4	CT_AFC_ServerValidation_AP_AFCDUSV35_NonMatchSAN_10632_1	PASS	-
3.5	3.5.4	CT_AFC_ServerValidation_AP_AFCDUSV35_DifferentRootCA_10633_1	PASS	-
3.5	3.5.4	CT_AFC_ServerValidation_AP_AFCDUSV35_MatchSuffixSAN_10634_1	PASS	-
3.5	3.5.4	CT_AFC_ServerValidation_AP_AFCDUSV35_ServerCertRevoked_10635_1	PASS	-
3.5	3.5.4	CT_AFC_ServerValidation_AP_AFCDUSV35_OCSPStaplingDisabled_10636_1	PASS	-
3.5	3.5.4	CT_AFC_ServerValidation_AP_AFCDUSV35_StapledOCSPRespExpired_10637_1	PASS	-
3.5	3.5.4	CT_AFC_ServerValidation_AP_AFCDUSV35_TLSCipherSuiteENULL_10638_1	PASS	-
3.5	3.5.4	CT_AFC_ServerValidation_AP_AFCDUSV35_NoRootCA_10639_1	PASS	-

**Conformity Assessment Condition:**

1. The test results (PASS/FAIL) with all measurement uncertainty excluded are presented against the regulation limits or in accordance with the requirements stipulated by the applicant/manufacturee who shall bear all the risks of non-compliance that may potentially occur if measurement uncertainty is taken into account.
2. The measurement uncertainty please refer to each test result in the chapter "Measurement Uncertainty".

Disclaimer:

The product specifications of the EUT presented in the test report that may affect the test assessments are declared by the manufacturer who shall take full responsibility for the authenticity.

Reviewed by: Sam Chen

Report Producer: Sophia Shiung



1 General Description

1.1 Product Feature of Equipment Under Test

Product Feature of Equipment Under Test	
Power Type	From power adapter or PoE
EUT Type	☒ Standard Power Access Point with Proxy ☐ Standard Power Access Point without Proxy ☐ Fixed Client with Proxy ☐ Fixed Client without Proxy
Condition of EUT	☒ Indoor ☐ Outdoor
Professional Installation	☒ Yes ☐ No
For CISCO SW:	
Firmware Version	17.13.1
Software Version	17.13.1
Hardware Version	Pre-Pilot
Proxy Firmware Version	17.13.1
Proxy Software Version	17.13.1
Proxy Hardware Version	N/A
For Meraki SW:	
Firmware Version	30-202308102048-G7305c1ab-rel-jockey
Software Version	r30
Hardware Version	meraki_CW9166D1 000000000
Proxy Firmware Version	N/A
Proxy Software Version	477245
Proxy Hardware Version	N/A

Note: The above information was declared by manufacturer.

1.2 Table for Multiple Listing

Model Name	SW	R1: 2.4GHz	R1: 5GHz Low Band or R1: 5GHz Full Band	R2: 5GHz High Band or 6GHz	R3: 2.4GHz/ 5GHz/6GHz	R4: Bluetooth or Zigbee
CW9166D1-B	Cisco	V	V (With 80+80MHz)	V	V	V (Disable Zigbee function by SW)
CW9166D1-MR	Meraki	V	V (Without 80+80MHz)	V	V	V

Note 1: The model CW9166D1-B and model CW9166D1-MR were both selected to test.

Note 2: The above information was declared by manufacturer.

1.3 Table for Radio function

Function Radio	WLAN 2.4GHz	WLAN 5GHz UNII 1~2A	WLAN 5GHz UNII 2C~3	WLAN 6GHz	Bluetooth	Zigbee
1 (Iron Radio)	V	V	V	-	-	-
2 (Pine Radio)	-	-	V	V	-	-
3 (Scanning Radio)	V	V	V	V	-	-
4	-	-	-	-	V	V

Note 1: The above information was declared by manufacturer.

Note 2: For WLAN 2.4GHz: The Radio 1 and Radio 3 can't operate at the same frequency.

For WLAN 5GHz: The Radio 1 ~ 3 can't operate at the same frequency.

For WLAN 6GHz: The Radio 2 ~ 3 can't operate at the same frequency simultaneously.

1.4 Table for EUT Operation Function

Mode	Operation Function
1	R1: 2.4GHz/5GHz Low Band+R2: 5GHz High band+R3: 2.4GHz+R4: Bluetooth
2	R1: 2.4GHz/5GHz Low Band+R2: 5GHz High band+R3: 5GHz+R4: Bluetooth
3	R1: 2.4GHz/5GHz Low Band+R2: 5GHz High band+R3: 6GHz (LPI mode)+R4: Bluetooth
4	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (LPI mode)+R3: 2.4GHz+R4: Bluetooth
5	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (LPI mode)+R3: 5GHz+R4: Bluetooth
6	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (LPI mode)+R3: 6GHz (LPI mode)+R4: Bluetooth
7	R1: 2.4GHz/5GHz Low Band+R2: 5GHz High band+R3: 2.4GHz+R4: Zigbee
8	R1: 2.4GHz/5GHz Low Band+R2: 5GHz High band+R3: 5GHz+R4: Zigbee
9	R1: 2.4GHz/5GHz Low Band+R2: 5GHz High band+R3: 6GHz (LPI mode)+R4: Zigbee
10	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (LPI mode)+R3: 2.4GHz+R4: Zigbee
11	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (LPI mode)+R3: 5GHz+R4: Zigbee
12	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (LPI mode)+R3: 6GHz (LPI mode)+R4: Zigbee
13	R1: 2.4GHz/5GHz Low Band+R2: 5GHz High band+R3: 6GHz (Standard Power mode)+R4: Bluetooth
14	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (Standard Power mode)+R3: 2.4GHz+R4: Bluetooth
15	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (Standard Power mode)+R3: 5GHz+R4: Bluetooth
16	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (Standard Power mode)+R3: 6GHz (Standard Power mode)+R4: Bluetooth
17	R1: 2.4GHz/5GHz Low Band+R2: 5GHz High band+R3: 6GHz (Standard Power mode)+R4: Zigbee
18	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (Standard Power mode)+R3: 2.4GHz+R4: Zigbee
19	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (Standard Power mode)+R3: 5GHz+R4: Zigbee
20	R1: 2.4GHz/5GHz Full Band+R2: 6GHz (Standard Power mode)+R3: 6GHz (Standard Power mode)+R4: Zigbee

Note: The above information was declared by manufacturer.

1.5 Accessories

Wall-mounted rack*1



1.6 Table for Permissive Change

This product is an extension of original one reported under Sporton project number: 313002.

Below is the table for the change of the product with respect to the original one.

Modifications	Performance Checking
Adding Standard Power mode for the EUT	AFC DUT Test Harness

1.7 Support Equipment

For CISCO SW:

Support Equipment				
No.	Equipment	Brand Name	Model Name	FCC ID
A	Notebook	DELL	E4300	N/A
B	Notebook	DELL	E4300	N/A
C	WLAN module	Intel	AX210NGW	PD9AX210NG
D	Notebook	DELL	E4300	N/A
E	Proxy	Cisco	C9800-L-C-K9	N/A
F	AC Adapter	DELTA	ADH-65AR B	N/A

For Meraki SW:

Support Equipment				
No.	Equipment	Brand Name	Model Name	FCC ID
A	Notebook	DELL	E4300	N/A
B	Notebook	DELL	E4300	N/A
C	WLAN module	Intel	AX210NGW	PD9AX210NG
D	Notebook	DELL	E4300	N/A
E	PoE	DELTA	ADH-65AR B	N/A



1.8 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- ♦ 47 CFR FCC Part 15.407

The following reference test guidance is not within the scope of accreditation of TAF.

- ♦ AFC Device (AFC DUT) Compliance Test Plan Version 1.5
- ♦ FCC KDB 987594 D05 v01r01

1.9 Testing Location

Testing Location Information	
Test Lab. : Sporton International Inc. Hsinchu Laboratory	
Hsinchu	ADD: No.8, Ln. 724, Bo'ai St., Zhubei City, Hsinchu County 302010, Taiwan (R.O.C.)
(TAF: 3787)	TEL: 886-3-656-9065 FAX: 886-3-656-9085
Test site Designation No. TW3787 with FCC.	
Conformity Assessment Body Identifier (CABID) TW3787 with ISED.	

Test Condition	Test Site No.	Test Engineer	Test Environment (°C / %)	Test Date
RF Conducted (For CISCO SW)	TH01-CB	Jeff Wu	22.1~22.8 / 62~67	Sep. 21, 2023
RF Conducted (For Meraki SW)	TH01-CB	Caster Chang	23.5~23.8 / 54~57	Sep. 13, 2023~ Oct. 04, 2023



2 Measurement Environment

Measurement Environment Information	
AFC DUT Test Harness version	2.0.65.148

2.1 AFCD General Capabilities Declaration

For CISCO SW:


Item	Question	Vendor Response
1	AFC DUT Type	Standard Power AP with Proxy
2	Does the AFC DUT supports sending an Available Spectrum Inquiry Request based on the inquired Frequency Range field?	No
3	Does the AFC DUT supports sending an Available Spectrum Inquiry Request based on the inquired Channels fields?	Yes
4	If the Answer to Items 2 and 3 is "Yes", what is AFC DUT's default inquiry type?	-
5	Does the AFC DUT need to be supplied with BSS configuration parameters?	Yes
6	Does the AFC DUT manufacturer attest to AFC DUT compliance with rules for LPI operation?	Yes
7	Does the AFC DUT need to be supplied with mandatory registration information to formulate an Available Spectrum Inquiry Request	No
8	If the Answer to Item 7 is "Yes". What is the geographic Supported by the AFC DUT?	-
9	Does the AFC DUT supports 160 MHz channel width operation?	Yes
10	Which method does AFC DUT acting as a Fixed Client uses for sending an Available Spectrum Inquiry Request?	-

For CISCO SW:


Item	Question	Vendor Response
1	AFC DUT Type	Standard Power AP with Proxy
2	Does the AFC DUT supports sending an Available Spectrum Inquiry Request based on the inquired Frequency Range field?	Yes
3	Does the AFC DUT supports sending an Available Spectrum Inquiry Request based on the inquired Channels fields?	No
4	If the Answer to Items 2 and 3 is "Yes", what is AFC DUT's default inquiry type?	-
5	Does the AFC DUT need to be supplied with BSS configuration parameters?	No
6	Does the AFC DUT manufacturer attest to AFC DUT compliance with rules for LPI operation?	Yes
7	Does the AFC DUT need to be supplied with mandatory registration information to formulate an Available Spectrum Inquiry Request	No
8	If the Answer to Item 7 is "Yes". What is the geographic Supported by the AFC DUT?	-
9	Does the AFC DUT supports 160 MHz channel width operation?	Yes
10	Which method does AFC DUT acting as a Fixed Client uses for sending an Available Spectrum Inquiry Request?	-

Note: The above information was declared by manufacturer.

2.2 Test Configuration

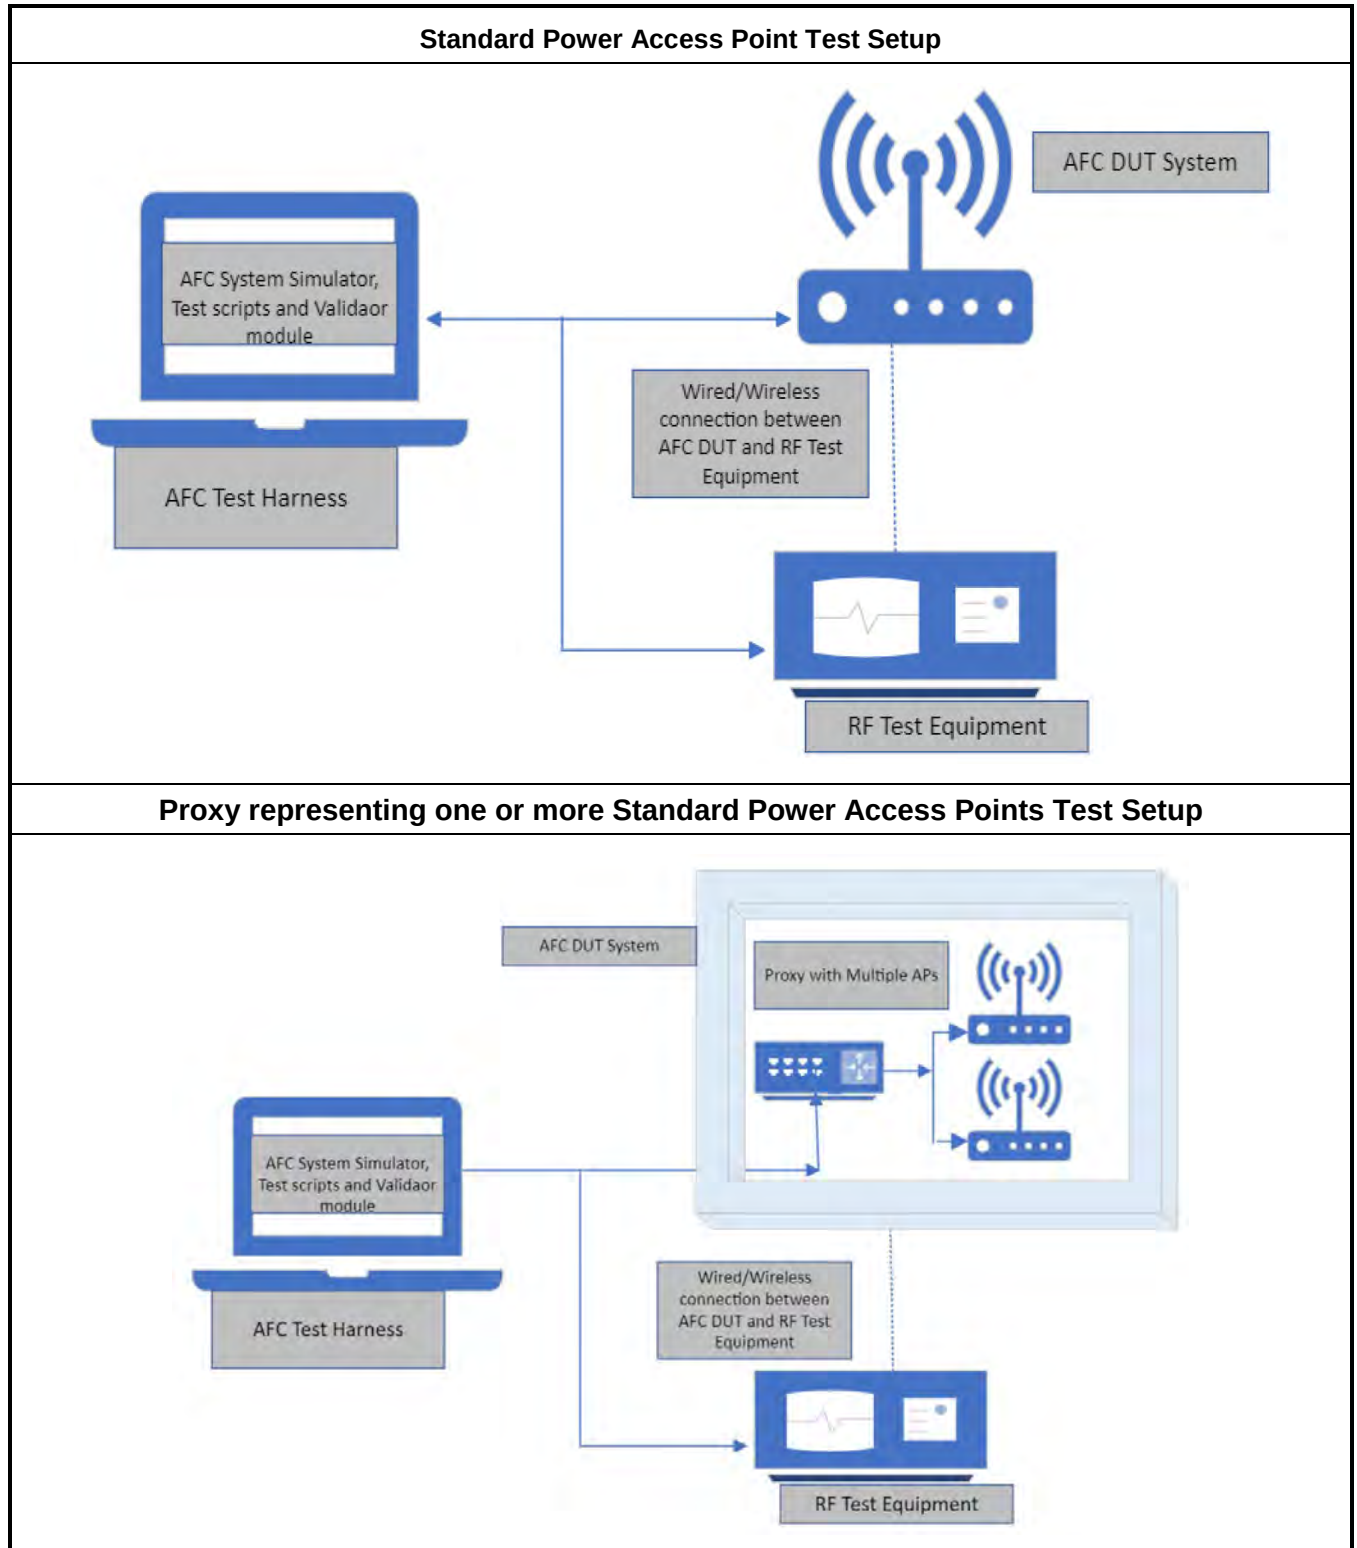

Fixed Client Device Test Setup

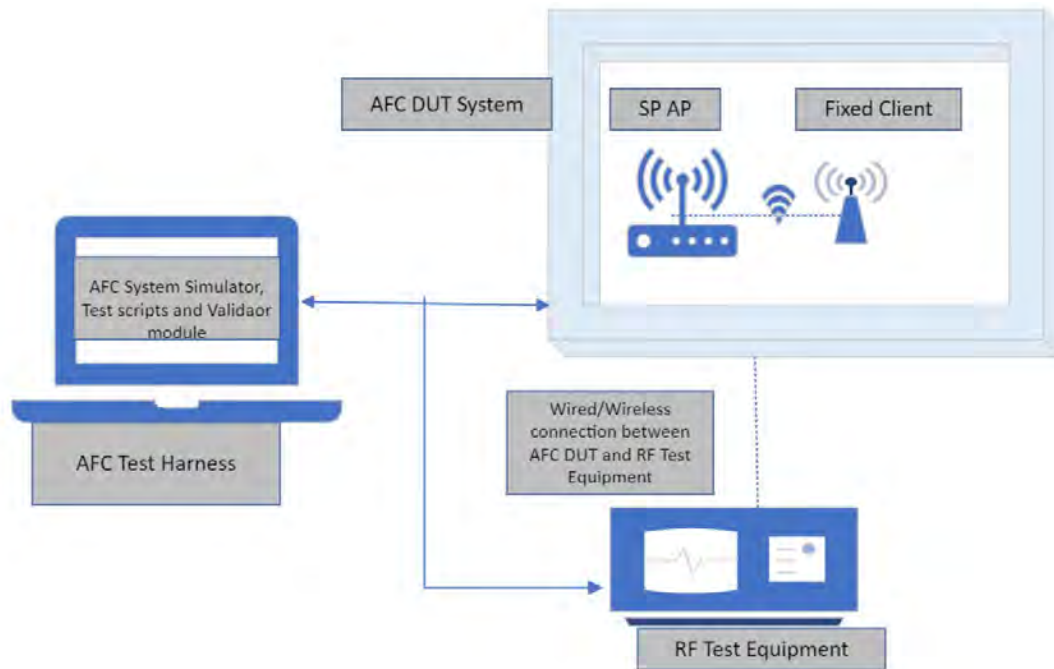



3 Protocol Test Results

3.1 Successful Registration and Spectrum Access Request

3.1.1 Test Procedure

Step	Description
1	If the AFC DUT is Standard Power Access Point, go to Step 2, else go to Step 12
2	AFC DUT set to Initial Pre-test State. If needed (see Table 5 declaration), configure the AFC DUT with BSS parameters per Table 9 and a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request.
3	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquired Frequency Range and/or the inquired Channels fields*.
4	AFC DUT Test Harness validates the presence of mandatory registration information
5	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.
6	Throughout Step 1 to Step 4, RF Test Equipment monitors the output of the AFC DUT to confirm that the AFC DUT does not transmit: - In the band if the AFC DUT supports only SP operation Or - Above LPI limits for AFC DUT whose manufacturer attests to its compliance with rules for LPI operation Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the following: - For SP only operation, AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies. - For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, AFC DUT transmit power in the band is less than CEILING [LPI limits, SP limits contained in the Available Spectrum Inquiry Response] and does not exceed emissions limits in adjacent frequencies.
7	Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request.
8	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*.
9	AFC DUT Test Harness validates the presence of mandatory registration information
10	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields which are significantly different from Step 5.
11	Wait for 5 minutes (configurable) RF Test Equipment monitors any transmission by the AFC DUT conforms to the following: - For SP only operation, AFC DUT conforms to the conditions contained in the latest Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies. - For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, AFC DUT transmit power in the band is less than CEILING [LPI limits, SP limits contained in the latest Available Spectrum Inquiry Response] and does not exceed emissions limits in adjacent frequencies.
12	If the AFC DUT is Fixed Client, go to Step 13 else Stop the test
13	The AFC DUT set to Initial Pre-test State.
14	If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request using either In-band or Out-of-band methods.
15	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*
16	AFC DUT Test Harness validates the presence of mandatory registration information
17	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.



18	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor
19	Wait for 60 seconds
20	RF Test Equipment monitors any transmission by the AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies
21	Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request using either In-band or Out-of-band methods
22	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*
23	AFC DUT Test Harness validates the presence of mandatory registration information
24	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields which are significantly different from Step 17.
25	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor
	Wait for 60 seconds (configurable)
	RF Test Equipment monitors any transmission by the AFC DUT conforms to the conditions contained in the latest Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies

3.1.2 Test Result

Refer as Appendix A~C



3.2 Unsuccessful Spectrum Access Request

3.2.1 Test Procedure

Step	Description
1	If the AFC DUT is Standard Power Access Point, go to Step 2, else go to Step 7
2	AFC DUT set to Initial Pre-test State. If needed (see Table 5 declaration), configure the AFC DUT with BSS parameters per Table 9 and a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request.
3	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*.
4	AFC DUT Test Harness validates mandatory registration information.
5	AFC DUT Test Harness sends an Available Spectrum Inquiry Response indicating that no frequency ranges and/or channels are available.
6	Throughout Step 2 to Step 5 and subsequent to Step 5, RF Test Equipment monitors the output of the AFC DUT to confirm the following: • For SP only operation, AFC DUT does not transmit in the band. • For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, the AFC DUT does not transmit above LPI limits.
7	If the AFC DUT is Fixed Client, go to Step 8 else Stop the test
8	The AFC DUT set to Initial Pre-test State.
9	If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID or IC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request.
10	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*.
11	AFC DUT Test Harness validates mandatory registration information.
12	AFC DUT Test Harness sends an Available Spectrum Inquiry Response indicating that no frequency ranges and/or channels are available using either In-band or Out-of-band methods.
13	If AFC DUT used Out-of-band method, initiate connection procedure between Fixed Client and SP Access Point by following instructions provided by the AFC DUT Vendor
13	Wait for 60 seconds RF Test Equipment monitors that the AFC DUT does not transmit above maximum transmit power limits advertised by the Standard Power Access Point for Standard Client Devices in the channel.

3.2.2 Test Result

Refer as Appendix A~C



3.3 Successful Spectrum Access Update

3.3.1 Test Procedure

Step	Description
1	If the AFC DUT is Standard Power Access Point, go to Step 2, else go to Step 12
2	AFC DUT set to Initial Pre-test State. If needed (see Table 5 declaration), configure the DUT with BSS parameters per Table 9 and a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request.
3	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*.
4	AFC DUT Harness validates mandatory registration information.
5	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.
6	Throughout the preceding steps, RF Test Equipment monitors the output of the AFC DUT to confirm that the AFC DUT does not transmit: • In the band if the AFC DUT supports only SP operation Or • Above LPI limits for AFC DUT whose manufacturer attests to its compliance with rules for LPI operation Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the following: • For SP only operation, AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies. • For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, AFC DUT transmit power in the band is less than CEILING [LPI limits, SP limits contained in the Available Spectrum Inquiry Response] and does not exceed emissions limits in adjacent frequencies.
7	AFC DUT is power cycled. If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID), new geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate.
8	Wait for 60 seconds If the AFC DUT does not send an Available Spectrum Inquiry Request, RF Test Equipment monitors the output of the AFC DUT to verify the following and STOP the test • For SP only operation, AFC DUT does not transmit in the band. • For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, the AFC DUT does not transmit above LPI limits. If the AFC DUT sends an Available Spectrum Inquiry Request, then CONTINUE with Step 9
9	AFC DUT Test Harness evaluates validity of mandatory registration information
10	AFC DUT Test Harness waits for 60 seconds before sending an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields which are significantly different from Step 5. • During the 60 seconds wait time: • For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, RF Test Equipment monitors the output of the AFC DUT to confirm that AFC DUT does not transmit above LPI threshold limits • For SP only operation, RF Test Equipment monitors the output of the AFC DUT to confirm that AFC DUT doesn't transmit in the band
11	Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the following: • For SP only operation, AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies. • For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, AFC DUT transmit power in the band is less than CEILING [LPI limits, SP limits contained in the Available Spectrum Inquiry Response] and does not exceed emissions limits in adjacent frequencies.
12	If the AFC DUT is Fixed Client, go to Step 13 else Stop the test
13	The AFC DUT set to Initial Pre-test State.



14	If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request using either In-band or Out-of- band methods.
15	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*
16	AFC DUT Test Harness validates the presence of mandatory registration information
17	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.
18	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor
19	Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies
20	AFC DUT is power cycled. If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID), new geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate
21	Wait for 60 seconds If the AFC DUT does not send an Available Spectrum Inquiry Request, RF Test Equipment monitors the output of the AFC DUT to verify the AFC DUT does not transmit above maximum transmit power limits advertised by the Standard Power Access Point for Standard Client Devices in the channel and STOP the test. If the AFC DUT sends an Available Spectrum Inquiry Request, then CONTINUE with Step 21
22	AFC DUT Test Harness evaluates validity of mandatory registration information
23	AFC DUT Test Harness waits for 60 seconds before sending an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields which are significantly different from step 17. During the 60 seconds wait time, RF Test Equipment monitors the output of the AFC DUT to confirm that the AFC DUT does not transmit above maximum transmit power limits advertised by the Standard Power Access Point for Standard Client Devices in the channel.
24	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor
25	Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies

3.3.2 Test Result

Refer as Appendix A~C



3.4 Unsuccessful Spectrum Access Update

3.4.1 Test Procedure

Step	Description
1	If the AFC DUT is Standard Power Access Point, go to Step 2, else go to Step 12
2	AFC DUT set to Initial Pre-test State. If needed (see Table 5 declaration), configure the AFC DUT with BSS parameters per Table 9 and a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the DUT with AFC System URL and server root certificate. Trigger the DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request using either In-band or Out-of-band methods.
3	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields.
4	AFC DUT Test Harness validates mandatory registration information
5	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.
6	Throughout the Step 2 to 5, RF Test Equipment monitors the output of the AFC DUT to confirm that the AFC DUT does not transmit: - In the band if the AFC DUT supports only SP operation Or - Above LPI limits for AFC DUT whose manufacturer attests to its compliance with rules for LPI operation Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the following: - For SP only operation, AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies. For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, AFC DUT transmit power in the band is less than CEILING [LPI limits, SP limits contained in the Available Spectrum Inquiry Response] and does not exceed emissions limits in adjacent frequencies
7	AFC DUT is power cycled. If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID), new geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate.
8	Wait for 60 seconds - If the AFC DUT does not send an Available Spectrum Inquiry Request, RF Test Equipment monitors the output of the DUT to verify the following and STOP the test: - For SP only operation, AFC DUT does not transmit in the band, - For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, the AFC DUT does not transmit above LPI limits. - If the AFC DUT sends an Available Spectrum Inquiry Request, then CONTINUE with Step 8
9	AFC DUT Test Harness evaluates validity of mandatory registration information.
10	AFC DUT Test Harness sends an Available Spectrum Inquiry Response indicating that no frequency ranges and/or channels are available.
11	Throughout Step 7 to 10 and subsequent to Step 10 Test Equipment monitors the output of the AFC DUT to confirm that: For SP only operation, AFC DUT does not transmit in the band. For AFC DUT whose manufacturer attests to its compliance with rules for LPI operation, the AFC DUT does not transmit above LPI limits.
12	If the AFC DUT is Fixed Client, go to Step 13 else Stop the test
13	The AFC DUT set to Initial Pre-test State.
14	If needed (see Table 5 declaration), configure the DUT with a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate. Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request using either In-band or Out-of- band methods.
15	AFC DUT sends a valid Available Spectrum Inquiry Request containing the inquiredFrequencyRange and/or the inquiredChannels fields*
16	AFC DUT Test Harness validates the presence of mandatory registration information
17	AFC DUT Test Harness sends an Available Spectrum Inquiry Response containing a list of available frequency



	ranges and/or channels and the maximum permissible transmit power in the availableFrequencyInfo and/or availableChannelInfo fields.
18	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor
19	Wait for 60 seconds RF Test Equipment monitors any transmission by the AFC DUT conforms to the conditions contained in the Available Spectrum Inquiry Response and does not exceed emissions limits in adjacent frequencies
20	AFC DUT is power cycled. If needed (see Table 5 declaration), configure the AFC DUT with a temporary test regulatory identifier (e.g., FCC ID or IC ID), new geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT with AFC System URL and server root certificate
21	Wait for 60 seconds If the AFC DUT does not send an Available Spectrum Inquiry Request, RF Test Equipment monitors that the AFC DUT does not transmit above maximum transmit power limits advertised by the Standard Power Access Point for Standard Client Devices in the channel., If the AFC DUT sends an Available Spectrum Inquiry Request, then CONTINUE with Step 22 else STOP the test
22	AFC DUT Test Harness evaluates validity of mandatory registration information.
23	AFC DUT Test Harness sends an Available Spectrum Inquiry Response indicating that no frequency ranges and/or channels are available.
24	If AFC DUT used Out-of-band method, initiate connection procedure between AFC DUT and SP Access Point by following instructions provided by the AFC DUT Vendor
25	Wait for 60 seconds RF Test Equipment monitors that the AFC DUT does not transmit above maximum transmit power limits advertised by the Standard Power Access Point for Standard Client Devices in the channel.

3.4.2 Test Result

Refer as Appendix A~C



3.5 Unsuccessful Server Validation

3.5.1 Test Procedure

Step	Description
1	The AFC DUT set to Initial Pre-test State. If needed (see Table 5 declaration), configure the AFC DUT with BSS parameters per Table 9 and a temporary test regulatory identifier (e.g., FCC ID), geographic coordinates, antenna height, and uncertainty parameters. Configure the AFC DUT Test Harness with TLS configuration that is the same as the default configuration defined in Section 2.3.1 except for the following: - Run 1: A different server certificate (and private key) with SAN domain name entry "badafc.com" (i.e. that does not match AFC system URL's domain name); signed by the same root certificate as per Section 2.3.1 - Run 2: A different server certificate (and private key) where all attributes other than Public Key are the same as the server certificate per Section 2.3.1, but the certificate is signed by a different root certificate - Run 3: A different server certificate (and private key) with SAN domain name entry "wfatestorg.org" only (i.e. SAN domain name only matches suffix of AFC server's hostname); signed by the same root certificate as per Section 2.3.1 - Run 4: A different server certificate (and private key) where all attributes other than Public Key are the same as the server certificate per Section 2.3.1 signed by the same root certificate as per Section 2.3.1, but the server certificate is revoked as indicated in stapled OCSP response - Run 5: Same configuration as per Section 2.3.1, except OCSP stapling is disabled and CRL/OCSP servers are not available - Run 6: Same configuration as per Section 2.3.1, except stapled OCSP response has expired and CRL/OCSP servers are not available - Run 7: Same configuration as per Section 2.3.1, except only the TLS cipher suite "eNULL" (no encryption) is enabled - Run 8: N/A (same configuration as per Section 2.3.1) Configure the AFC DUT with the AFC System URL and the following root certificate: - Runs 1-7: Root certificate as per Section 2.3.1 - Run 8: No root certificate Trigger the AFC DUT to send to the AFC DUT Test Harness an Available Spectrum Inquiry Request using either In-band or Out-of-band methods.
2	AFC DUT Test Harness waits 10 seconds, and verifies no Available Spectrum Inquiry Request is sent to it.
3	Steps 1 and 2 are repeated for each of the remaining Runs

3.5.2 Test Result

Refer as Appendix A



4 Test Equipment and Calibration Data

Instrument	Brand	Model No.	Serial No.	Characteristics	Calibration Date	Calibration Due Date	Remark
Spectrum analyzer	R&S	FSV40	100979	9kHz~40GHz	May 29, 2023	May 28, 2024	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-06	1 GHz – 18 GHz	Oct. 03, 2022	Oct. 02, 2023	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-06	1 GHz – 18 GHz	Oct. 02, 2023	Oct. 01, 2024	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-07	1 GHz – 18 GHz	Oct. 03, 2022	Oct. 02, 2023	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-07	1 GHz – 18 GHz	Oct. 02, 2023	Oct. 01, 2024	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-08	1 GHz – 18 GHz	Oct. 03, 2022	Oct. 02, 2023	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-08	1 GHz – 18 GHz	Oct. 02, 2023	Oct. 01, 2024	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-09	1 GHz – 18 GHz	Oct. 03, 2022	Oct. 02, 2023	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-09	1 GHz – 18 GHz	Oct. 02, 2023	Oct. 01, 2024	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-10	1 GHz – 18 GHz	Oct. 03, 2022	Oct. 02, 2023	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-10	1 GHz – 18 GHz	Oct. 02, 2023	Oct. 01, 2024	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-30	1 GHz – 18 GHz	Oct. 03, 2022	Oct. 02, 2023	Conducted (TH01-CB)
RF Cable-high	Woken	RG402	High Cable-30	1 GHz – 18 GHz	Oct. 02, 2023	Oct. 01, 2024	Conducted (TH01-CB)
RF Power Divider	MTJ	2 Way	DF01-DV-03	1GHz ~ 8GHz	Oct. 04, 2022	Oct. 03, 2023	Conducted (TH01-CB)
RF Power Divider	STI	2 Way	DV-8G -05	1GHz ~ 8GHz	Oct. 03, 2023	Oct. 02, 2024	Conducted (TH01-CB)
RF Power Divider	MTJ	2 Way	DF01-DV-02	1GHz ~ 8GHz	Oct. 04, 2022	Oct. 03, 2023	Conducted (TH01-CB)
RF Power Divider	STI	2 Way	DV-8G -06	1GHz ~ 8GHz	Oct. 03, 2023	Oct. 02, 2024	Conducted (TH01-CB)
RF Power Divider	STI	2 Way	DV-8G -07	1GHz ~ 8GHz	Oct. 03, 2023	Oct. 02, 2024	Conducted (TH01-CB)
RF Power Divider	STI	2 Way	DV-8G -08	1GHz ~ 8GHz	Oct. 03, 2023	Oct. 02, 2024	Conducted (TH01-CB)
Test Software	SPORTON	SENSE	V5.10	-	N.C.R.	N.C.R.	Conducted (TH01-CB)

Note: Calibration Interval of instruments listed above is one year.

NCR means Non-Calibration required.



5 Measurement Uncertainty

Test Items	Uncertainty	Remark
Conducted Emission	3.1 dB	Confidence levels of 95%

AFC DUT Compliance Test Report

DUT Information

AFC DUT System	Standard Power AP with Proxy
DUT Vendor Name	Cisco
DUT Product Model	CW9166D1-B

Test Result

FCC Requirements	TestCaseName	Test Result
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_NoRootCA_10639_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_TLSCipherSuiteENULL_10638_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_StapledOCSPRespExpired_10637_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_OCSPStaplingDisabled_10636_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_ServerCertRevoked_10635_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_MatchSuffixSAN_10634_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_DifferentRootCA_10633_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_NonMatchSAN_10632_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(9)(i)	CT_AFC_SP_AP_AFCDUAU34_Channel_10624_1 (Unsuccessful spectrum access update)	PASS
15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(9)(i)	CT_AFC_SP_AP_AFCDUAU33_Channel_10623_1 (Successful spectrum access update)	PASS
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii)	CT_AFC_SP_AP_AFCDUSA32_Channel_10622_1 (Unsuccessful registration and spectrum access request)	PASS
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii), 15.407(l)(ii), 15.407(k)(8)(iv)	CT_AFC_SP_AP_AFCDRSA31_Channel_160MHz_10621_1 (Successful registration and spectrum access request)	PASS
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii), 15.407(l)(ii), 15.407(k)(8)(iv)	CT_AFC_SP_AP_AFCDRSA31_Channel_80MHz_10620_1 (Successful registration and spectrum access request)	PASS
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii), 15.407(l)(ii), 15.407(k)(8)(iv)	CT_AFC_SP_AP_AFCDRSA31_Channel_40MHz_10619_1 (Successful registration and spectrum access request)	PASS
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii), 15.407(l)(ii), 15.407(k)(8)(iv)	CT_AFC_SP_AP_AFCDRSA31_Channel_20MHz_10618_1 (Successful registration and spectrum access request)	PASS

Test Measurements

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_NoRootCA_10639_1 (Unsuccessful server validation)
 TestResult: PASS
 Band: 6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_TLSCipherSuiteENULL_10638_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_StapledOCSPRespExpired_10637_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_OCSPStaplingDisabled_10636_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_ServerCertRevoked_10635_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_MatchSuffixSAN_10634_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_DifferentRootCA_10633_1 (Unsuccessful server validation)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_NonMatchSAN_10632_1 (Unsuccessful server validation)

TestResult:PASS

Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_SP_AP_AFCDU34_Channel_10624_1 (Unsuccessful spectrum access update)

TestResult:PASS

Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (36.0 dBm EIRP) in Spectrum Reponse] on channel 53 bandwidth 20.	true	PASS
AFC_DUT_SP_OPERATION_NO_REQ	AFC DUT transmit with standard power in the band in no Spectrum Inquiry Request case	false	PASS

TestCaseName: CT_AFC_SP_AP_AFCD34U33_Channel_10623_1 (Successful spectrum access update)

TestResult:PASS

Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION_1	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (26.17626787716448 dBm EIRP) in Spectrum Reponse] on channel 53 bandwidth 20.	true	PASS
AFC_DUT_SP_OPERATION_NO_REQ	AFC DUT transmit with standard power in the band in no Spectrum Inquiry Request case	false	PASS

TestCaseName: CT_AFC_SP_AP_AFCD34U32_Channel_10622_1 (Unsuccessful registration and spectrum access request)

TestResult:PASS

Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS

	Inquiry Request		
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE	AFC DUT conforms to the conditions in the Spectrum Inquiry Response	true	PASS

TestCaseName: CT_AFC_SP_AP_AFCDRSA31_Channel_160MHz_10621_1 (Successful registration and spectrum access request)
 TestResult: PASS
 Band: 6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_1	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (30.27643341425931 dBm EIRP) in Spectrum Reponse] on channel center frequency index 143 bandwidth 160.	true	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_2	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_2	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_2	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (31.052999421496587 dBm EIRP) in Spectrum Reponse] on channel center frequency index 47 bandwidth 160.	true	PASS

TestCaseName: CT_AFC_SP_AP_AFCDRSA31_Channel_80MHz_10620_1 (Successful registration and spectrum access request)
 TestResult: PASS
 Band: 6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_1	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (31.263599572230937 dBm EIRP) in Spectrum Reponse] on channel center frequency index 55 bandwidth 80.	true	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_2	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_2	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_2	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (33.15943959133935 dBm EIRP) in Spectrum Reponse] on channel center frequency index 87 bandwidth 80.	true	PASS

TestCaseName: CT_AFC_SP_AP_AFCDRSA31_Channel_40MHz_10619_1 (Successful registration and spectrum access request)
 TestResult: PASS
 Band: 6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_1	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (30.729563560523545 dBm EIRP) in Spectrum Reponse] on channel center frequency index 19 bandwidth 40.	true	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_2	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_2	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_2	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (24.20903830704715 dBm EIRP) in Spectrum Reponse] on channel center frequency index 35 bandwidth 40.	true	PASS

TestCaseName: CT_AFC_SP_AP_AFCDRSA31_Channel_20MHz_10618_1 (Successful registration and spectrum access request)
 TestResult: PASS
 Band: 6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_1	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (22.207125305991738 dBm EIRP) in Spectrum Reponse] on channel 37 bandwidth 20.	true	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_2	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_2	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_2	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (26.92851681561458 dBm EIRP) in Spectrum Reponse] on channel 149 bandwidth 20.	true	PASS

AFC DUT Compliance Test Report

DUT Information

AFC DUT System	Standard Power AP with Proxy
DUT Vendor Name	Cisco
DUT Product Model	CW9166D1-MR

Test Result

FCC Requirements	Test Case Name	Test Result
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_NoRootCA_10639_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_TLSCipherSuiteENULL_10638_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_StapledOCSPRespExpired_10637_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_OCSPStaplingDisabled_10636_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_ServerCertRevoked_10635_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_MatchSuffixSAN_10634_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_DifferentRootCA_10633_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(v)	CT_AFC_ServerValidation_AP_AFCDUSV35_NonMatchSAN_10632_1 (Unsuccessful server validation)	PASS
15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(9)(i)	CT_AFC_SP_AP_AFCDUAU34_Frequency_10617_1 (Unsuccessful spectrum access update)	PASS
15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(9)(i)	CT_AFC_SP_AP_AFCDUAU33_Frequency_10616_1 (Successful spectrum access update)	PASS
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii)	CT_AFC_SP_AP_AFCDUSA32_Frequency_10615_1 (Unsuccessful registration and spectrum access request)	PASS
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii), 15.407(l)(ii), 15.407(k)(8)(iv)	CT_AFC_SP_AP_AFCDRSA31_Frequency_160MHz_10614_1 (Successful registration and spectrum access request)	PASS
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii), 15.407(l)(ii), 15.407(k)(8)(iv)	CT_AFC_SP_AP_AFCDRSA31_Frequency_80MHz_10613_1 (Successful registration and spectrum access request)	PASS
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii), 15.407(l)(ii), 15.407(k)(8)(iv)	CT_AFC_SP_AP_AFCDRSA31_Frequency_40MHz_10612_1 (Successful registration and spectrum access request)	PASS
15.407(k)(1), 15.407(k)(8)(i), 15.407(k)(8)(ii), 15.407(k)(8)(iii), 15.407(l)(ii), 15.407(k)(8)(iv)	CT_AFC_SP_AP_AFCDRSA31_Frequency_20MHz_10611_1 (Successful registration and spectrum access request)	PASS

Test Measurements

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_NoRootCA_10639_1 (Unsuccessful server validation)
 TestResult: PASS
 Band: 6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_TLSCipherSuiteENULL_10638_1 (Unsuccessful server validation)
 TestResult:PASS
 Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_StapledOCSPRespExpired_10637_1 (Unsuccessful server validation)
 TestResult:PASS
 Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_OCSPStaplingDisabled_10636_1 (Unsuccessful server validation)
 TestResult:PASS
 Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_ServerCertRevoked_10635_1 (Unsuccessful server validation)
 TestResult:PASS
 Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_MatchSuffixSAN_10634_1 (Unsuccessful server validation)
 TestResult:PASS
 Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_DifferentRootCA_10633_1 (Unsuccessful server validation)
 TestResult:PASS
 Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_ServerValidation_AP_AFCDUSV35_NonMatchSAN_10632_1 (Unsuccessful server validation)

TestResult:PASS

Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	false	PASS

TestCaseName: CT_AFC_SP_AP_AFCDU4U34_Frequency_10617_1 (Unsuccessful spectrum access update)

TestResult:PASS

Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (23 dBm/MHz PSD) in Spectrum Reponse] on channel 5 bandwidth 20.	true	PASS
AFC_DUT_CONFORM_ADJACENT_FREQUENCIES_EMISSIONS_LIMITS	AFC DUT conforms to not exceed emissions limits in adjacent frequencies	true	PASS

AFC_DUT_SP_OPERATION_NO_REQ	AFC DUT transmit with standard power in the band in no Spectrum Inquiry Request case	false	PASS
-----------------------------	--	-------	------

TestCaseName: CT_AFC_SP_AP_AFCD5AU33_Frequency_10616_1 (Successful spectrum access update)

TestResult:PASS

Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION_1	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (20.630817176615196 dBm/MHz PSD) in Spectrum Reponse] on channel 69 bandwidth 20.	true	PASS
AFC_DUT_CONFORM_ADJACENT_FREQUENCIES_EMISSIONS_LIMITS_1	AFC DUT conforms to not exceed emissions limits in adjacent frequencies	true	PASS
AFC_DUT_SP_OPERATION_NO_REQ	AFC DUT transmit with standard power in the band in	false	PASS

	no Spectrum Inquiry Request case		
--	----------------------------------	--	--

TestCaseName: CT_AFC_SP_AP_AFCDUSA32_Frequency_10615_1 (Unsuccessful registration and spectrum access request)
TestResult:PASS
Band:6GHz

Measurement Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE	AFC DUT conforms to the conditions in the Spectrum Inquiry Response	true	PASS

TestCaseName: CT_AFC_SP_AP_AFCDRSA31_Frequency_160MHz_10614_1 (Successful registration and spectrum access request)
TestResult:PASS
Band:6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS

AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_1	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (8.319359167903224 dBm/MHz PSD) in Spectrum Reponse] on channel center frequency index 15 bandwidth 160.	true	PASS
AFC_DUT_CONFORM_ADJACENT_FREQUENCIES_EMISSIONS_LIMITS_1	AFC DUT conforms to not exceed emissions limits in adjacent frequencies	true	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_2	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_2	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_2	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (8.82901561124943 dBm/MHz PSD) in Spectrum Reponse] on channel center frequency index 47 bandwidth 160.	true	PASS
AFC_DUT_CONFORM_ADJACENT_FREQUENCIES_EMISSIONS_LIMITS_2	AFC DUT conforms to not exceed emissions limits in adjacent frequencies	true	PASS

TestCaseName: CT_AFC_SP_AP_AFCDRSA31_Frequency_80MHz_10613_1 (Successful registration and spectrum access request)
 TestResult: PASS
 Band: 6GHz

Measurement Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_1	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD), SP limits (15.045367247926919 dBm/MHz PSD) in Spectrum Reponse] on channel center frequency index 135 bandwidth 80.	true	PASS
AFC_DUT_CONFORM_ADJACENT_FREQUENCIES_EMISSIONS_LIMITS_1	AFC DUT conforms to not exceed emissions limits in adjacent frequencies	true	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_2	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_2	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_2	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD), SP limits (11.817265029250745 dBm/MHz PSD) in Spectrum Reponse] on channel center frequency index 7 bandwidth 80.	true	PASS
AFC_DUT_CONFORM_ADJACENT_FREQUENCIES_EMISSIONS_LIMITS_2	AFC DUT conforms to not exceed emissions limits in adjacent frequencies	true	PASS

TestCaseName: CT_AFC_SP_AP_AFCDRSA31_Frequency_40MHz_10612_1 (Successful registration and spectrum access request)
 TestResult: PASS
 Band: 6GHz

Measurement Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_1	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD), SP limits (14.815316155751361 dBm/MHz PSD) in Spectrum Reponse] on channel center frequency index 35 bandwidth 40.	true	PASS
AFC_DUT_CONFORM_ADJACENT_FREQUENCIES_EMISSIONS_LIMITS_1	AFC DUT conforms to not exceed emissions limits in	true	PASS

	adjacent frequencies		
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_2	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_2	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_2	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (17.143828727693453 dBm/MHz PSD) in Spectrum Reponse] on channel center frequency index 83 bandwidth 40.	true	PASS
AFC_DUT_CONFORM_ADJACENT_FREQUENCIES_EMISSIONS_LIMITS_2	AFC DUT conforms to not exceed emissions limits in adjacent frequencies	true	PASS

TestCaseName: CT_AFC_SP_AP_AFCDRSA31_Frequency_20MHz_10611_1 (Successful registration and spectrum access request)
 TestResult: PASS
 Band: 6GHz

Measurements Name	Description	Value	Validation Result
AFC_DUT_SP_OPERATION	AFC DUT transmit with standard power in the band before the Spectrum Inquiry Response	false	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_1	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_1	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_1	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (15.176428675053529 dBm/MHz PSD) in Spectrum Reponse] on channel 149 bandwidth 20.	true	PASS
AFC_DUT_CONFORM_ADJACENT_FREQUENCIES_EMISSIONS_LIMITS_1	AFC DUT conforms to not exceed emissions limits in adjacent frequencies	true	PASS
AFC_DUT_SEND_SPECTRUM_INQUIRYREQUEST_2	AFC DUT sends an Available Spectrum Inquiry Request	true	PASS
AFC_DUT_SPECTRUM_INQUIRYREQUEST_VALID_2	Valid mandatory registration information	true	PASS
AFC_DUT_CONFORM_SPECTRUM_INQUIRYRESPONSE_2	AFC DUT transmit power in the band is less than CEILING[LPI limits (5 dBm/MHz PSD) , SP limits (18.252962770852385 dBm/MHz PSD) in Spectrum Reponse] on channel 5 bandwidth 20.	true	PASS
AFC_DUT_CONFORM_ADJACENT_FREQUENCIES_EMISSIONS_LIMITS_2	AFC DUT conforms to not exceed emissions limits in adjacent frequencies	true	PASS

AFC capability - Inquired Channel**CT_AFC_SP_AP_AFCRSA31_Channel_20MHz_10618_1**

2023-09-21T01:54:03Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Accept-Encoding": "deflate, gzip",
    "Content-Type": "application/json",
    "X-Forwarded-For": "192.100.100.254",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "1702",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "17789456456611047425",
        "deviceDescriptor": {
          "serialNumber": "KWC271505S8",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "LDK-9160S2579"
            }
          ]
        },
        "location": {
          "ellipse": {
            "center": {
              "longitude": -121.91889,
              "latitude": 37.416858
            },
            "majorAxis": 25,
            "minorAxis": 25,

```



```
"orientation": 0.0
},
"elevation": {
  "height": 15,
  "heightType": "AGL",
  "verticalUncertainty": 5
},
"indoorDeployment": 1
},
"inquiredChannels": [
  {
    "globalOperatingClass": 131,
    "channelCfi": [
      1,
      5,
      9,
      13,
      17,
      21,
      25,
      29,
      33,
      37,
      41,
      45,
      49,
      53,
      57,
      61,
      65,
      69,
      73,
      77,
      81,
      85,
      89,
      93,
```



```
97,  
101,  
105,  
109,  
113,  
117,  
121,  
125,  
129,  
133,  
137,  
141,  
145,  
149,  
153,  
157,  
161,  
165,  
169,  
173,  
177,  
181,  
185,  
189,  
193,  
197,  
201,  
205,  
209,  
213,  
217,  
221,  
225,  
229,  
233  
]  
,
```

```
{
  "globalOperatingClass": 132,
  "channelCfi": [
    3,
    11,
    19,
    27,
    35,
    43,
    51,
    59,
    67,
    75,
    83,
    91,
    99,
    107,
    115,
    123,
    131,
    139,
    147,
    155,
    163,
    171,
    179,
    187,
    195,
    203,
    211,
    219,
    227
  ]
},
{
  "globalOperatingClass": 133,
  "channelCfi": [
```

```
        7,  
        23,  
        39,  
        55,  
        71,  
        87,  
        103,  
        119,  
        135,  
        151,  
        167,  
        183,  
        199,  
        215  
    ]  
},  
{  
    "globalOperatingClass": 134,  
    "channelCfi": [  
        15,  
        47,  
        79,  
        111,  
        143,  
        175,  
        207  
    ]  
}  
],  
"vendorExtensions": [  
    {  
        "extensionId": "APInfo",  
        "parameters": {  
            "version": "v1",  
            "PID": "CW9166D1-B",  
            "countryCode": "US "  
        }  
    }  
]
```



```
        }
      ]
    }
  ],
  "vendorExtensions": [
    {
      "extensionId": "XEControllerInfo",
      "parameters": {
        "version": "v1",
        "extendedDebugEnable": "False",
        "chassisInfo": [
          {
            "role": "active",
            "PID": "C9800-L-C-K9",
            "SN": "FCL2649004F"
          }
        ],
        "licenseInfo": {
          "licensingType": "air-dna-advantage",
          "count": 0,
          "lastRumAckReceived": "<none>",
          "countAPsRequiringAFC": 1
        }
      }
    }
  ]
}
```

2023-09-21T01:54:03Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
    },
  ],
}
```

```
"availableChannelInfo": [  
  {  
    "channelCfi": [  
      1,  
      5,  
      9,  
      13,  
      17,  
      21,  
      25,  
      29,  
      33,  
      37,  
      41,  
      45,  
      49,  
      53,  
      57,  
      61,  
      65,  
      69,  
      73,  
      77,  
      81,  
      85,  
      89,  
      93  
    ],  
    "globalOperatingClass": 131,  
    "maxEirp": [  
      24.54015172966718,  
      33.53952118779434,  
      26.111591635501853,  
      32.596538370559784,  
      26.027872887374947,  
      27.78702489001052,  
      28.245691691967238,  
    ]  
  }  
]
```

```
21.60128433516993,  
24.940480947424422,  
22.207125305991738,  
30.479746993406806,  
34.163028929169236,  
25.49146876079279,  
27.91760051953716,  
30.140446355551678,  
28.63198363269906,  
30.69951681363618,  
25.19358185923045,  
34.14463446820331,  
21.567713767732222,  
33.79637330902534,  
29.12187972953237,  
31.675003011315617,  
22.172214630856367  
]  
,  
{  
  "channelCfi": [  
    3,  
    11,  
    19,  
    27,  
    35,  
    43,  
    51,  
    59,  
    67,  
    75,  
    83,  
    91  
  ],  
  "globalOperatingClass": 132,  
  "maxEirp": [  
    27.550451686306992,
```

```
        29.121891592141665,  
        29.03817284401476,  
        24.61158429180974,  
        25.21742526263155,  
        33.49004695004662,  
        28.501768717432604,  
        31.642283589338874,  
        28.20388181587026,  
        24.578013724372035,  
        32.13217968617218,  
        25.18251458749618  
    ]  
},  
{  
    "channelCfi": [  
        7,  
        23,  
        39,  
        55,  
        71,  
        87  
    ],  
    "globalOperatingClass": 133,  
    "maxEirp": [  
        30.5607516429468,  
        27.621884248449554,  
        28.22772521927136,  
        31.51206867407241,  
        27.588313681011847,  
        28.192814544135985  
    ]  
},  
{  
    "channelCfi": [  
        15,  
        47,  
        79
```

```
    ],
    "globalOperatingClass": 134,
    "maxEirp": [
        30.632184205089366,
        31.238025175911176,
        30.59861363765166
    ]
}

],
"requestId": "17789456456611047425",
"availabilityExpireTime": "2023-09-22T01:54:03Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}

],
"version": "1.4"
}
```

```
##### 2023-09-21T01:57:59Z #####
{
    "headers": {
        "Host": "testserver.wfatestorg.org",
        "Accept": "*/*",
        "Accept-Encoding": "deflate, gzip",
        "Content-Type": "application/json",
        "X-Forwarded-For": "192.100.100.254",
        "X-Forwarded-Host": "testserver.wfatestorg.org",
        "X-Forwarded-Server": "testserver.wfatestorg.org",
        "Content-Length": "1702",
        "Connection": "Keep-Alive"
    },
    "body": {
        "version": "1.4",
        "availableSpectrumInquiryRequests": [
            {
                "requestId": "17789456456611047426",
                "deviceDescriptor": {
                    "serialNumber": "KWC271505S8",

```



```
"certificationId": [  
  {  
    "rulesetId": "US_47_CFR_PART_15_SUBPART_E",  
    "id": "LDK-9160S2579"  
  }  
]  
,  
"location": {  
  "ellipse": {  
    "center": {  
      "longitude": -121.91889,  
      "latitude": 37.416858  
    },  
    "majorAxis": 25,  
    "minorAxis": 25,  
    "orientation": 0.0  
  },  
  "elevation": {  
    "height": 10,  
    "heightType": "AGL",  
    "verticalUncertainty": 5  
  },  
  "indoorDeployment": 1  
},  
"inquiredChannels": [  
  {  
    "globalOperatingClass": 131,  
    "channelCfi": [  
      1,  
      5,  
      9,  
      13,  
      17,  
      21,  
      25,  
      29,  
      33,
```

37,
41,
45,
49,
53,
57,
61,
65,
69,
73,
77,
81,
85,
89,
93,
97,
101,
105,
109,
113,
117,
121,
125,
129,
133,
137,
141,
145,
149,
153,
157,
161,
165,
169,
173,
177,
181,

```
        185,  
        189,  
        193,  
        197,  
        201,  
        205,  
        209,  
        213,  
        217,  
        221,  
        225,  
        229,  
        233  
    ]  
},  
{  
    "globalOperatingClass": 132,  
    "channelCfi": [  
        3,  
        11,  
        19,  
        27,  
        35,  
        43,  
        51,  
        59,  
        67,  
        75,  
        83,  
        91,  
        99,  
        107,  
        115,  
        123,  
        131,  
        139,  
        147,
```

```
        155,
        163,
        171,
        179,
        187,
        195,
        203,
        211,
        219,
        227
    ]
},
{
    "globalOperatingClass": 133,
    "channelCfi": [
        7,
        23,
        39,
        55,
        71,
        87,
        103,
        119,
        135,
        151,
        167,
        183,
        199,
        215
    ]
},
{
    "globalOperatingClass": 134,
    "channelCfi": [
        15,
        47,
        79,
```

```
        111,
        143,
        175,
        207
    ]
}
],
"vendorExtensions": [
    {
        "extensionId": "APInfo",
        "parameters": {
            "version": "v1",
            "PID": "CW9166D1-B",
            "countryCode": "US "
        }
    }
]
}
],
"vendorExtensions": [
    {
        "extensionId": "XEControllerInfo",
        "parameters": {
            "version": "v1",
            "extendedDebugEnable": "False",
            "chassisInfo": [
                {
                    "role": "active",
                    "PID": "C9800-L-C-K9",
                    "SN": "FCL2649004F"
                }
            ],
            "licenseInfo": {
                "licensingType": "air-dna-advantage",
                "count": 0,
                "lastRumAckReceived": "<none>",
                "countAPsRequiringAFC": 1
            }
        }
    }
]
```



```
    }
  }
}

}

##### 2023-09-21T01:57:59Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            129,
            133,
            137,
            141,
            145,
            149,
            153,
            157
          ],
          "globalOperatingClass": 131,
          "maxEirp": [
            34.5336615725773,
            26.42546176140413,
            26.83033060911415,
            21.871948996740922,
            21.236668599217737,
            26.92851681561458,
            21.06880533503341,
            25.71816985729258
          ]
        }
      ]
    }
  ]
}
```

```
    ]
  },
  {
    "channelCfi": [
      131,
      139,
      147,
      155
    ],
    "globalOperatingClass": 132,
    "maxEirp": [
      29.435761718043942,
      24.882248953380735,
      24.24696855585755,
      24.079105291673223
    ]
  },
  {
    "channelCfi": [
      135,
      151
    ],
    "globalOperatingClass": 133,
    "maxEirp": [
      27.892548910020544,
      27.08940524831303
    ]
  },
  {
    "channelCfi": [
      143
    ],
    "globalOperatingClass": 134,
    "maxEirp": [
      30.099705204952848
    ]
  }
}
```



```
    ],  
    "requestId": "17789456456611047426",  
    "availabilityExpireTime": "2023-09-22T01:57:59Z",  
    "rulesetId": "US_47_CFR_PART_15_SUBPART_E"  
  }  
],  
"version": "1.4"  
}
```

CT_AFC_SP_AP_AFCDRSA31_Channel_40MHz_10619_1

2023-09-21T02:08:31Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Accept-Encoding": "deflate, gzip",
    "Content-Type": "application/json",
    "X-Forwarded-For": "192.100.100.254",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "1702",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "17789456456611047427",
        "deviceDescriptor": {
          "serialNumber": "KWC271505S8",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -121.91889,
          "latitude": 37.416858
        },
        "majorAxis": 25,
        "minorAxis": 25,
        "orientation": 0.0
      }
    }
  }
}
```

```
    },
    "elevation": {
      "height": 15,
      "heightType": "AGL",
      "verticalUncertainty": 5
    },
    "indoorDeployment": 1
  },
  "inquiredChannels": [
    {
      "globalOperatingClass": 131,
      "channelCfi": [
        1,
        5,
        9,
        13,
        17,
        21,
        25,
        29,
        33,
        37,
        41,
        45,
        49,
        53,
        57,
        61,
        65,
        69,
        73,
        77,
        81,
        85,
        89,
        93,
        97,
```



```
101,  
105,  
109,  
113,  
117,  
121,  
125,  
129,  
133,  
137,  
141,  
145,  
149,  
153,  
157,  
161,  
165,  
169,  
173,  
177,  
181,  
185,  
189,  
193,  
197,  
201,  
205,  
209,  
213,  
217,  
221,  
225,  
229,  
233  
]  
,  
{
```



```
"globalOperatingClass": 132,  
"channelCfi": [  
    3,  
    11,  
    19,  
    27,  
    35,  
    43,  
    51,  
    59,  
    67,  
    75,  
    83,  
    91,  
    99,  
    107,  
    115,  
    123,  
    131,  
    139,  
    147,  
    155,  
    163,  
    171,  
    179,  
    187,  
    195,  
    203,  
    211,  
    219,  
    227  
]  
},  
{  
    "globalOperatingClass": 133,  
    "channelCfi": [  
        7,
```

```
        23,
        39,
        55,
        71,
        87,
        103,
        119,
        135,
        151,
        167,
        183,
        199,
        215
    ]
},
{
    "globalOperatingClass": 134,
    "channelCfi": [
        15,
        47,
        79,
        111,
        143,
        175,
        207
    ]
}
],
"vendorExtensions": [
    {
        "extensionId": "APInfo",
        "parameters": {
            "version": "v1",
            "PID": "CW9166D1-B",
            "countryCode": "US "
        }
    }
]
```

```
    ]
  }
],
"vendorExtensions": [
  {
    "extensionId": "XEControllerInfo",
    "parameters": {
      "version": "v1",
      "extendedDebugEnable": "False",
      "chassisInfo": [
        {
          "role": "active",
          "PID": "C9800-L-C-K9",
          "SN": "FCL2649004F"
        }
      ],
      "licenseInfo": {
        "licensingType": "air-dna-advantage",
        "count": 0,
        "lastRumAckReceived": "<none>",
        "countAPsRequiringAFC": 1
      }
    }
  }
]
}
```

2023-09-21T02:08:31Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
```

```
{  
  "channelCfi": [  
    1,  
    5,  
    9,  
    13,  
    17,  
    21,  
    25,  
    29,  
    129,  
    133,  
    137,  
    141,  
    145,  
    149,  
    153,  
    157  
  ],  
  "globalOperatingClass": 131,  
  "maxEirp": [  
    25.791403816166614,  
    31.107873546263097,  
    29.017764751787304,  
    25.60484847649454,  
    29.234361489851867,  
    27.719263603883732,  
    25.318226219334008,  
    30.13234772613717,  
    30.483629144875064,  
    23.904763345710307,  
    24.917547873135312,  
    33.61649669046315,  
    30.342192390918274,  
    29.314420385135467,  
    28.173997637753295,  
    29.88384949662414  
  ]  
}
```

```
    ]
  },
  {
    "channelCfi": [
      3,
      11,
      19,
      27,
      131,
      139,
      147,
      155
    ],
    "globalOperatingClass": 132,
    "maxEirp": [
      28.801703772806427,
      28.61514843313435,
      30.729563560523545,
      28.32852617597382,
      26.91506330235012,
      27.927847829775125,
      32.324720341775276,
      31.184297594393108
    ]
  },
  {
    "channelCfi": [
      7,
      23,
      135,
      151
    ],
    "globalOperatingClass": 133,
    "maxEirp": [
      31.625448389774157,
      31.33882613261363,
      29.925363258989925,
```

```
        34.19459755103291
      ]
    },
    {
      "channelCfi": [
        15,
        143
      ],
      "globalOperatingClass": 134,
      "maxEirp": [
        34.349126089253446,
        32.935663215629745
      ]
    }
  ],
  "requestId": "17789456456611047427",
  "availabilityExpireTime": "2023-09-22T02:08:31Z",
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}

],
"version": "1.4"
}

##### 2023-09-21T02:16:19Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Accept-Encoding": "deflate, gzip",
    "Content-Type": "application/json",
    "X-Forwarded-For": "192.100.100.254",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "1702",
    "Connection": "Keep-Alive"
  },
  "body": {
```



```
"version": "1.4",
"availableSpectrumInquiryRequests": [
  {
    "requestId": "17789456456611047428",
    "deviceDescriptor": {
      "serialNumber": "KWC271505S8",
      "certificationId": [
        {
          "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
          "id": "LDK-9160S2579"
        }
      ]
    },
    "location": {
      "ellipse": {
        "center": {
          "longitude": -121.91889,
          "latitude": 37.416858
        },
        "majorAxis": 25,
        "minorAxis": 25,
        "orientation": 0.0
      },
      "elevation": {
        "height": 10,
        "heightType": "AGL",
        "verticalUncertainty": 5
      },
      "indoorDeployment": 1
    },
    "inquiredChannels": [
      {
        "globalOperatingClass": 131,
        "channelCfi": [
          1,
          5,
          9,
```

13,
17,
21,
25,
29,
33,
37,
41,
45,
49,
53,
57,
61,
65,
69,
73,
77,
81,
85,
89,
93,
97,
101,
105,
109,
113,
117,
121,
125,
129,
133,
137,
141,
145,
149,
153,
157,

```
        161,  
        165,  
        169,  
        173,  
        177,  
        181,  
        185,  
        189,  
        193,  
        197,  
        201,  
        205,  
        209,  
        213,  
        217,  
        221,  
        225,  
        229,  
        233  
    ]  
},  
{  
    "globalOperatingClass": 132,  
    "channelCfi": [  
        3,  
        11,  
        19,  
        27,  
        35,  
        43,  
        51,  
        59,  
        67,  
        75,  
        83,  
        91,  
        99,
```

```
        107,  
        115,  
        123,  
        131,  
        139,  
        147,  
        155,  
        163,  
        171,  
        179,  
        187,  
        195,  
        203,  
        211,  
        219,  
        227  
    ]  
},  
{  
    "globalOperatingClass": 133,  
    "channelCfi": [  
        7,  
        23,  
        39,  
        55,  
        71,  
        87,  
        103,  
        119,  
        135,  
        151,  
        167,  
        183,  
        199,  
        215  
    ]  
},
```

```
{
  "globalOperatingClass": 134,
  "channelCfi": [
    15,
    47,
    79,
    111,
    143,
    175,
    207
  ]
},
"vendorExtensions": [
  {
    "extensionId": "APInfo",
    "parameters": {
      "version": "v1",
      "PID": "CW9166D1-B",
      "countryCode": "US "
    }
  }
],
"vendorExtensions": [
  {
    "extensionId": "XEControllerInfo",
    "parameters": {
      "version": "v1",
      "extendedDebugEnable": "False",
      "chassisInfo": [
        {
          "role": "active",
          "PID": "C9800-L-C-K9",
          "SN": "FCL2649004F"
        }
      ]
    }
  }
]
```

```
    ],
    "licenseInfo": {
      "licensingType": "air-dna-advantage",
      "count": 1,
      "lastRumAckReceived": "<none>",
      "countAPsRequiringAFC": 1
    }
  }
}
]
```

2023-09-21T02:16:19Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            33,
            37,
            41,
            45,
            49,
            53,
            57,
            61,
            65,
            69,
            73,
            77,
            81,
```

```
      85,  
      89,  
      93  
    ],  
    "globalOperatingClass": 131,  
    "maxEirp": [  
      27.04105822964347,  
      21.19873835040734,  
      23.395323372715026,  
      29.414907716245196,  
      32.95970292439376,  
      23.38228237951932,  
      32.062587647175306,  
      31.11401485004373,  
      25.074078862955407,  
      23.846675093500735,  
      31.63410917578521,  
      34.25195053565819,  
      21.986471191333212,  
      33.583527255201794,  
      30.90872607866417,  
      23.202420653437258  
    ]  
  },  
  {  
    "channelCfi": [  
      35,  
      43,  
      51,  
      59,  
      67,  
      75,  
      83,  
      91  
    ],  
    "globalOperatingClass": 132,  
    "maxEirp": [  

```



```
        24.20903830704715,  
        26.40562332935484,  
        26.392582336159133,  
        34.12431480668354,  
        26.856975050140548,  
        34.644409132425025,  
        24.996771147973025,  
        26.21272061007707  
    ]  
},  
{  
    "channelCfi": [  
        39,  
        55,  
        71,  
        87  
    ],  
    "globalOperatingClass": 133,  
    "maxEirp": [  
        27.21933826368696,  
        29.402882292798942,  
        29.867275006780357,  
        28.007071104612834  
    ]  
},  
{  
    "channelCfi": [  
        47,  
        79  
    ],  
    "globalOperatingClass": 134,  
    "maxEirp": [  
        30.229638220326777,  
        31.01737106125265  
    ]  
}  
],
```



```
"requestId": "17789456456611047428",  
  "availabilityExpireTime": "2023-09-22T02:16:19Z",  
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"  
},  
"version": "1.4"  
}
```

CT_AFC_SP_AP_AFCDSA31_Channel_80MHz_10620_1

2023-09-21T06:10:27Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Accept-Encoding": "deflate, gzip",
    "Content-Type": "application/json",
    "X-Forwarded-For": "192.100.100.254",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "1702",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "17789456456611047437",
        "deviceDescriptor": {
          "serialNumber": "KWC271505S8",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -121.91889,
          "latitude": 37.416858
        },
        "majorAxis": 25,
        "minorAxis": 25,
        "orientation": 0.0
      }
    }
  }
}
```

```
    },
    "elevation": {
      "height": 15,
      "heightType": "AGL",
      "verticalUncertainty": 5
    },
    "indoorDeployment": 1
  },
  "inquiredChannels": [
    {
      "globalOperatingClass": 131,
      "channelCfi": [
        1,
        5,
        9,
        13,
        17,
        21,
        25,
        29,
        33,
        37,
        41,
        45,
        49,
        53,
        57,
        61,
        65,
        69,
        73,
        77,
        81,
        85,
        89,
        93,
        97,
```



```
101,  
105,  
109,  
113,  
117,  
121,  
125,  
129,  
133,  
137,  
141,  
145,  
149,  
153,  
157,  
161,  
165,  
169,  
173,  
177,  
181,  
185,  
189,  
193,  
197,  
201,  
205,  
209,  
213,  
217,  
221,  
225,  
229,  
233  
]  
,  
{
```

```
"globalOperatingClass": 132,  
"channelCfi": [  
    3,  
    11,  
    19,  
    27,  
    35,  
    43,  
    51,  
    59,  
    67,  
    75,  
    83,  
    91,  
    99,  
    107,  
    115,  
    123,  
    131,  
    139,  
    147,  
    155,  
    163,  
    171,  
    179,  
    187,  
    195,  
    203,  
    211,  
    219,  
    227  
]  
},  
{  
    "globalOperatingClass": 133,  
    "channelCfi": [  
        7,
```

```
        23,
        39,
        55,
        71,
        87,
        103,
        119,
        135,
        151,
        167,
        183,
        199,
        215
    ]
},
{
    "globalOperatingClass": 134,
    "channelCfi": [
        15,
        47,
        79,
        111,
        143,
        175,
        207
    ]
}
],
"vendorExtensions": [
    {
        "extensionId": "APInfo",
        "parameters": {
            "version": "v1",
            "PID": "CW9166D1-B",
            "countryCode": "US "
        }
    }
]
```



```
    ]
  }
],
"vendorExtensions": [
  {
    "extensionId": "XEControllerInfo",
    "parameters": {
      "version": "v1",
      "extendedDebugEnable": "False",
      "chassisInfo": [
        {
          "role": "active",
          "PID": "C9800-L-C-K9",
          "SN": "FCL2649004F"
        }
      ],
      "licenseInfo": {
        "licensingType": "air-dna-advantage",
        "count": 1,
        "lastRumAckReceived": "<none>",
        "countAPsRequiringAFC": 1
      }
    }
  }
]
}
```

2023-09-21T06:10:27Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
```

```
{
  "channelCfi": [
    33,
    37,
    41,
    45,
    49,
    53,
    57,
    61
  ],
  "globalOperatingClass": 131,
  "maxEirp": [
    30.10765268789687,
    29.816971144192955,
    32.918004705609945,
    21.851288287440596,
    25.242999658951316,
    30.165113503207223,
    32.898942192046334,
    31.003243491662424
  ]
},
{
  "channelCfi": [
    35,
    43,
    51,
    59
  ],
  "globalOperatingClass": 132,
  "maxEirp": [
    32.82727110083277,
    24.86158824408041,
    28.25329961559113,
    34.01354344830224
  ]
}
```

```
    },
    {
      "channelCfi": [
        39,
        55
      ],
      "globalOperatingClass": 133,
      "maxEirp": [
        27.87188820072022,
        31.263599572230937
      ]
    },
    {
      "channelCfi": [
        47
      ],
      "globalOperatingClass": 134,
      "maxEirp": [
        30.882188157360034
      ]
    }
  ],
  "requestId": "17789456456611047437",
  "availabilityExpireTime": "2023-09-22T06:10:27Z",
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}
```

2023-09-21T06:16:51Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Accept-Encoding": "deflate, gzip",
    "Content-Type": "application/json",
```

```
"X-Forwarded-For": "192.100.100.254",
"X-Forwarded-Host": "testserver.wfatestorg.org",
"X-Forwarded-Server": "testserver.wfatestorg.org",
"Content-Length": "1702",
"Connection": "Keep-Alive"
},
"body": {
  "version": "1.4",
  "availableSpectrumInquiryRequests": [
    {
      "requestId": "17789456456611047438",
      "deviceDescriptor": {
        "serialNumber": "KWC271505S8",
        "certificationId": [
          {
            "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
            "id": "LDK-9160S2579"
          }
        ]
      }
    }
  ],
  "location": {
    "ellipse": {
      "center": {
        "longitude": -121.91889,
        "latitude": 37.416858
      },
      "majorAxis": 25,
      "minorAxis": 25,
      "orientation": 0.0
    },
    "elevation": {
      "height": 10,
      "heightType": "AGL",
      "verticalUncertainty": 5
    },
    "indoorDeployment": 1
  }
},
```

```
"inquiredChannels": [  
  {  
    "globalOperatingClass": 131,  
    "channelCfi": [  
      1,  
      5,  
      9,  
      13,  
      17,  
      21,  
      25,  
      29,  
      33,  
      37,  
      41,  
      45,  
      49,  
      53,  
      57,  
      61,  
      65,  
      69,  
      73,  
      77,  
      81,  
      85,  
      89,  
      93,  
      97,  
      101,  
      105,  
      109,  
      113,  
      117,  
      121,  
      125,  
      129,  
    ]  
  }  
]
```

```
133,  
137,  
141,  
145,  
149,  
153,  
157,  
161,  
165,  
169,  
173,  
177,  
181,  
185,  
189,  
193,  
197,  
201,  
205,  
209,  
213,  
217,  
221,  
225,  
229,  
233  
]  
,  
{  
  "globalOperatingClass": 132,  
  "channelCfi": [  
    3,  
    11,  
    19,  
    27,  
    35,  
    43,
```

```
51,  
59,  
67,  
75,  
83,  
91,  
99,  
107,  
115,  
123,  
131,  
139,  
147,  
155,  
163,  
171,  
179,  
187,  
195,  
203,  
211,  
219,  
227  
]  
,  
{  
  "globalOperatingClass": 133,  
  "channelCfi": [  
    7,  
    23,  
    39,  
    55,  
    71,  
    87,  
    103,  
    119,  
    135,
```

```
        151,
        167,
        183,
        199,
        215
    ]
},
{
    "globalOperatingClass": 134,
    "channelCfi": [
        15,
        47,
        79,
        111,
        143,
        175,
        207
    ]
}
],
"vendorExtensions": [
    {
        "extensionId": "APInfo",
        "parameters": {
            "version": "v1",
            "PID": "CW9166D1-B",
            "countryCode": "US "
        }
    }
]
}
],
"vendorExtensions": [
    {
        "extensionId": "XEControllerInfo",
        "parameters": {
            "version": "v1",
```



```
"extendedDebugEnabled": "False",
"chassisInfo": [
  {
    "role": "active",
    "PID": "C9800-L-C-K9",
    "SN": "FCL2649004F"
  }
],
"licenseInfo": {
  "licensingType": "air-dna-advantage",
  "count": 1,
  "lastRumAckReceived": "<none>",
  "countAPsRequiringAFC": 1
}
}
}
]
}
}
```

2023-09-21T06:16:51Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            1,
            5,
            9,
            13,
            17,
            21,
```

```
25,  
29,  
65,  
69,  
73,  
77,  
81,  
85,  
89,  
93,  
129,  
133,  
137,  
141,  
145,  
149,  
153,  
157  
],  
"globalOperatingClass": 131,  
"maxEirp": [  
28.1112702025693,  
25.29110731450036,  
23.21592192516667,  
30.255812199841394,  
24.517270338015397,  
32.0129576480941,  
34.155045179459435,  
32.81075609828111,  
23.887153845977018,  
24.58574006454387,  
25.564774131083965,  
25.41333871821126,  
33.13978331540436,  
27.138839678059725,  
30.920597036553133,  
28.22233758643301,
```

```
        21.707738105737555,  
        32.08227296297818,  
        24.79839372453116,  
        21.80058871000403,  
        33.46384061841738,  
        34.068861032144596,  
        34.20685342047592,  
        29.782971774542457  
    ]  
},  
{  
    "channelCfi": [  
        3,  
        11,  
        19,  
        27,  
        67,  
        75,  
        83,  
        91,  
        131,  
        139,  
        147,  
        155  
    ],  
    "globalOperatingClass": 132,  
    "maxEirp": [  
        28.30140727114017,  
        26.22622188180648,  
        27.52757029465521,  
        35.82105605492092,  
        26.89745380261683,  
        28.423638674851073,  
        30.149139634699537,  
        31.232637543072823,  
        24.718038062377367,  
        24.81088866664384,
```

```
        36.0,  
        32.79327173118227  
    ]  
},  
{  
    "channelCfi": [  
        7,  
        23,  
        71,  
        87,  
        135,  
        151  
    ],  
    "globalOperatingClass": 133,  
    "maxEirp": [  
        29.236521838446286,  
        30.53787025129502,  
        29.90775375925664,  
        33.15943959133935,  
        27.728338019017173,  
        35.80357168782208  
    ]  
},  
{  
    "channelCfi": [  
        15,  
        79,  
        143  
    ],  
    "globalOperatingClass": 134,  
    "maxEirp": [  
        32.246821795086106,  
        32.918053715896455,  
        30.738637975656992  
    ]  
}  
],
```



```
"requestId": "17789456456611047438",  
  "availabilityExpireTime": "2023-09-22T06:16:51Z",  
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"  
},  
"version": "1.4"  
}
```

CT_AFC_SP_AP_AFCDRSA31_Channel_160MHz_10621_1

2023-09-21T02:54:03Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Accept-Encoding": "deflate, gzip",
    "Content-Type": "application/json",
    "X-Forwarded-For": "192.100.100.254",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "1702",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "17789456456611047432",
        "deviceDescriptor": {
          "serialNumber": "KWC271505S8",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -121.91889,
          "latitude": 37.416858
        },
        "majorAxis": 25,
        "minorAxis": 25,
        "orientation": 0.0
      }
    }
  }
}
```

```
    },
    "elevation": {
      "height": 15,
      "heightType": "AGL",
      "verticalUncertainty": 5
    },
    "indoorDeployment": 1
  },
  "inquiredChannels": [
    {
      "globalOperatingClass": 131,
      "channelCfi": [
        1,
        5,
        9,
        13,
        17,
        21,
        25,
        29,
        33,
        37,
        41,
        45,
        49,
        53,
        57,
        61,
        65,
        69,
        73,
        77,
        81,
        85,
        89,
        93,
        97,
```

```
101,  
105,  
109,  
113,  
117,  
121,  
125,  
129,  
133,  
137,  
141,  
145,  
149,  
153,  
157,  
161,  
165,  
169,  
173,  
177,  
181,  
185,  
189,  
193,  
197,  
201,  
205,  
209,  
213,  
217,  
221,  
225,  
229,  
233  
]  
,  
{
```



```
"globalOperatingClass": 132,  
"channelCfi": [  
    3,  
    11,  
    19,  
    27,  
    35,  
    43,  
    51,  
    59,  
    67,  
    75,  
    83,  
    91,  
    99,  
    107,  
    115,  
    123,  
    131,  
    139,  
    147,  
    155,  
    163,  
    171,  
    179,  
    187,  
    195,  
    203,  
    211,  
    219,  
    227  
]  
},  
{  
    "globalOperatingClass": 133,  
    "channelCfi": [  
        7,
```

```
        23,
        39,
        55,
        71,
        87,
        103,
        119,
        135,
        151,
        167,
        183,
        199,
        215
    ]
},
{
    "globalOperatingClass": 134,
    "channelCfi": [
        15,
        47,
        79,
        111,
        143,
        175,
        207
    ]
}
],
"vendorExtensions": [
    {
        "extensionId": "APInfo",
        "parameters": {
            "version": "v1",
            "PID": "CW9166D1-B",
            "countryCode": "US "
        }
    }
]
```

```
    ]
  }
],
"vendorExtensions": [
  {
    "extensionId": "XEControllerInfo",
    "parameters": {
      "version": "v1",
      "extendedDebugEnable": "False",
      "chassisInfo": [
        {
          "role": "active",
          "PID": "C9800-L-C-K9",
          "SN": "FCL2649004F"
        }
      ],
      "licenseInfo": {
        "licensingType": "air-dna-advantage",
        "count": 1,
        "lastRumAckReceived": "<none>",
        "countAPsRequiringAFC": 1
      }
    }
  }
]
}
```

2023-09-21T02:54:03Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
```

```
{
  "channelCfi": [
    1,
    5,
    9,
    13,
    17,
    21,
    25,
    29,
    65,
    69,
    73,
    77,
    81,
    85,
    89,
    93,
    129,
    133,
    137,
    141,
    145,
    149,
    153,
    157
  ],
  "globalOperatingClass": 131,
  "maxEirp": [
    29.182688241409664,
    26.115610985900652,
    26.800946297530814,
    31.83658869435503,
    30.601314632438935,
    29.532983833544417,
    32.55705204742954,
    25.28073765468636,
```

```
        22.149391950389592,  
        33.490621509070095,  
        32.685380619701135,  
        23.031187880937587,  
        22.895885893335237,  
        28.224920815740315,  
        23.735792870239628,  
        23.881390165377955,  
        25.253918699353566,  
        21.245535544339873,  
        27.179569331542933,  
        23.872862653924933,  
        21.70597285392174,  
        29.22598467356393,  
        28.209093412011022,  
        22.849590092555374  
    ]  
},  
{  
    "channelCfi": [  
        3,  
        11,  
        19,  
        27,  
        67,  
        75,  
        83,  
        91,  
        131,  
        139,  
        147,  
        155  
    ],  
    "globalOperatingClass": 132,  
    "maxEirp": [  
        29.125910942540465,  
        29.811246254170626,
```

```
        32.54328379018423,  
        28.29103761132617,  
        25.159691907029405,  
        26.0414878375774,  
        25.90618584997505,  
        26.74609282687944,  
        24.255835500979686,  
        26.883162610564746,  
        24.716272810561552,  
        25.859890049195187  
    ]  
},  
{  
    "channelCfi": [  
        7,  
        23,  
        71,  
        87,  
        135,  
        151  
    ],  
    "globalOperatingClass": 133,  
    "maxEirp": [  
        32.13621089918027,  
        31.30133756796598,  
        28.169991863669214,  
        28.91648580661486,  
        27.266135457619498,  
        27.72657276720136  
    ]  
},  
{  
    "channelCfi": [  
        15,  
        79,  
        143  
    ],  
}
```

```
"globalOperatingClass": 134,
"maxEirp": [
    34.3116375246058,
    31.18029182030903,
    30.27643541425931
]
},
"requestId": "17789456456611047432",
"availabilityExpireTime": "2023-09-22T02:54:03Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}
```

```
##### 2023-09-21T02:59:59Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Accept-Encoding": "deflate, gzip",
    "Content-Type": "application/json",
    "X-Forwarded-For": "192.100.100.254",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "1702",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "17789456456611047433",
        "deviceDescriptor": {
          "serialNumber": "KWC271505S8",
          "certificationId": [

```

```
{
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
  "id": "LDK-9160S2579"
}
]
},
"location": {
  "ellipse": {
    "center": {
      "longitude": -121.91889,
      "latitude": 37.416858
    },
    "majorAxis": 25,
    "minorAxis": 25,
    "orientation": 0.0
  },
  "elevation": {
    "height": 10,
    "heightType": "AGL",
    "verticalUncertainty": 5
  },
  "indoorDeployment": 1
},
"inquiredChannels": [
  {
    "globalOperatingClass": 131,
    "channelCfi": [
      1,
      5,
      9,
      13,
      17,
      21,
      25,
      29,
      33,
      37,
```


41,
45,
49,
53,
57,
61,
65,
69,
73,
77,
81,
85,
89,
93,
97,
101,
105,
109,
113,
117,
121,
125,
129,
133,
137,
141,
145,
149,
153,
157,
161,
165,
169,
173,
177,
181,
185,

```
        189,  
        193,  
        197,  
        201,  
        205,  
        209,  
        213,  
        217,  
        221,  
        225,  
        229,  
        233  
    ]  
},  
{  
    "globalOperatingClass": 132,  
    "channelCfi": [  
        3,  
        11,  
        19,  
        27,  
        35,  
        43,  
        51,  
        59,  
        67,  
        75,  
        83,  
        91,  
        99,  
        107,  
        115,  
        123,  
        131,  
        139,  
        147,  
        155,
```

```
        163,  
        171,  
        179,  
        187,  
        195,  
        203,  
        211,  
        219,  
        227  
    ]  
},  
{  
    "globalOperatingClass": 133,  
    "channelCfi": [  
        7,  
        23,  
        39,  
        55,  
        71,  
        87,  
        103,  
        119,  
        135,  
        151,  
        167,  
        183,  
        199,  
        215  
    ]  
},  
{  
    "globalOperatingClass": 134,  
    "channelCfi": [  
        15,  
        47,  
        79,  
        111,
```

```
        143,
        175,
        207
    ]
}
],
"vendorExtensions": [
    {
        "extensionId": "APInfo",
        "parameters": {
            "version": "v1",
            "PID": "CW9166D1-B",
            "countryCode": "US "
        }
    }
]
}
],
"vendorExtensions": [
    {
        "extensionId": "XEControllerInfo",
        "parameters": {
            "version": "v1",
            "extendedDebugEnable": "False",
            "chassisInfo": [
                {
                    "role": "active",
                    "PID": "C9800-L-C-K9",
                    "SN": "FCL2649004F"
                }
            ],
            "licenseInfo": {
                "licensingType": "air-dna-advantage",
                "count": 1,
                "lastRumAckReceived": "<none>",
                "countAPsRequiringAFC": 1
            }
        }
    }
]
```

```
    }
  }
]
}
}

##### 2023-09-21T02:59:59Z #####

{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
        {
          "channelCfi": [
            33,
            37,
            41,
            45,
            49,
            53,
            57,
            61
          ],
          "globalOperatingClass": 131,
          "maxEirp": [
            28.092278868793713,
            25.926345177689825,
            29.878698913089117,
            33.67021242903971,
            24.09988244194153,
            22.02209955157715,
            33.528970694773754,
            33.26187826382617
          ]
        }
      ]
    }
  ]
}
```

```
    },  
    {  
      "channelCfi": [  
        35,  
        43,  
        51,  
        59  
      ],  
      "globalOperatingClass": 132,  
      "maxEirp": [  
        28.936645134329638,  
        32.88899886972893,  
        25.03239950821696,  
        36.0  
      ]  
    },  
    {  
      "channelCfi": [  
        39,  
        55  
      ],  
      "globalOperatingClass": 133,  
      "maxEirp": [  
        31.946945090969447,  
        28.04269946485677  
      ]  
    },  
    {  
      "channelCfi": [  
        47  
      ],  
      "globalOperatingClass": 134,  
      "maxEirp": [  
        31.052999421496587  
      ]  
    }  
  ],  
}
```



```
"requestId": "17789456456611047433",  
  "availabilityExpireTime": "2023-09-22T02:59:59Z",  
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"  
},  
"version": "1.4"  
}
```

CT_AFC_SP_AP_AFCDUSA32_Channel_10622_1

2023-09-21T03:10:19Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Accept-Encoding": "deflate, gzip",
    "Content-Type": "application/json",
    "X-Forwarded-For": "192.100.100.254",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "1702",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "17789456456611047434",
        "deviceDescriptor": {
          "serialNumber": "KWC271505S8",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -121.91889,
          "latitude": 37.416858
        },
        "majorAxis": 25,
        "minorAxis": 25,
        "orientation": 0.0
      }
    }
  }
}
```



```
    },
    "elevation": {
      "height": 15,
      "heightType": "AGL",
      "verticalUncertainty": 5
    },
    "indoorDeployment": 1
  },
  "inquiredChannels": [
    {
      "globalOperatingClass": 131,
      "channelCfi": [
        1,
        5,
        9,
        13,
        17,
        21,
        25,
        29,
        33,
        37,
        41,
        45,
        49,
        53,
        57,
        61,
        65,
        69,
        73,
        77,
        81,
        85,
        89,
        93,
        97,
```

```
101,  
105,  
109,  
113,  
117,  
121,  
125,  
129,  
133,  
137,  
141,  
145,  
149,  
153,  
157,  
161,  
165,  
169,  
173,  
177,  
181,  
185,  
189,  
193,  
197,  
201,  
205,  
209,  
213,  
217,  
221,  
225,  
229,  
233  
]  
,  
{
```

```
"globalOperatingClass": 132,  
"channelCfi": [  
    3,  
    11,  
    19,  
    27,  
    35,  
    43,  
    51,  
    59,  
    67,  
    75,  
    83,  
    91,  
    99,  
    107,  
    115,  
    123,  
    131,  
    139,  
    147,  
    155,  
    163,  
    171,  
    179,  
    187,  
    195,  
    203,  
    211,  
    219,  
    227  
]  
},  
{  
    "globalOperatingClass": 133,  
    "channelCfi": [  
        7,
```

```
        23,
        39,
        55,
        71,
        87,
        103,
        119,
        135,
        151,
        167,
        183,
        199,
        215
    ]
},
{
    "globalOperatingClass": 134,
    "channelCfi": [
        15,
        47,
        79,
        111,
        143,
        175,
        207
    ]
}
],
"vendorExtensions": [
    {
        "extensionId": "APInfo",
        "parameters": {
            "version": "v1",
            "PID": "CW9166D1-B",
            "countryCode": "US "
        }
    }
]
```

```
    ]
  }
],
"vendorExtensions": [
  {
    "extensionId": "XEControllerInfo",
    "parameters": {
      "version": "v1",
      "extendedDebugEnable": "False",
      "chassisInfo": [
        {
          "role": "active",
          "PID": "C9800-L-C-K9",
          "SN": "FCL2649004F"
        }
      ],
      "licenseInfo": {
        "licensingType": "air-dna-advantage",
        "count": 1,
        "lastRumAckReceived": "<none>",
        "countAPsRequiringAFC": 1
      }
    }
  }
]
}
```

2023-09-21T03:10:19Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [],
    }
  ]
}
```



```
"requestId": "17789456456611047434",  
  "availabilityExpireTime": "2023-09-22T03:10:19Z",  
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"  
},  
"version": "1.4"  
}
```

CT_AFC_SP_AP_AFCDSAU33_Channel_10623_1

2023-09-21T03:15:11Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Accept-Encoding": "deflate, gzip",
    "Content-Type": "application/json",
    "X-Forwarded-For": "192.100.100.254",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "1702",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "17789456456611047435",
        "deviceDescriptor": {
          "serialNumber": "KWC271505S8",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "LDK-9160S2579"
            }
          ]
        }
      },
      {
        "location": {
          "ellipse": {
            "center": {
              "longitude": -121.91889,
              "latitude": 37.416858
            },
            "majorAxis": 25,
            "minorAxis": 25,
            "orientation": 0.0
          }
        }
      }
    ]
  }
}
```

```
    },  
    "elevation": {  
      "height": 10,  
      "heightType": "AGL",  
      "verticalUncertainty": 5  
    },  
    "indoorDeployment": 1  
  },  
  "inquiredChannels": [  
    {  
      "globalOperatingClass": 131,  
      "channelCfi": [  
        1,  
        5,  
        9,  
        13,  
        17,  
        21,  
        25,  
        29,  
        33,  
        37,  
        41,  
        45,  
        49,  
        53,  
        57,  
        61,  
        65,  
        69,  
        73,  
        77,  
        81,  
        85,  
        89,  
        93,  
        97,
```




```
101,  
105,  
109,  
113,  
117,  
121,  
125,  
129,  
133,  
137,  
141,  
145,  
149,  
153,  
157,  
161,  
165,  
169,  
173,  
177,  
181,  
185,  
189,  
193,  
197,  
201,  
205,  
209,  
213,  
217,  
221,  
225,  
229,  
233  
]  
,  
{
```

```
"globalOperatingClass": 132,  
"channelCfi": [  
    3,  
    11,  
    19,  
    27,  
    35,  
    43,  
    51,  
    59,  
    67,  
    75,  
    83,  
    91,  
    99,  
    107,  
    115,  
    123,  
    131,  
    139,  
    147,  
    155,  
    163,  
    171,  
    179,  
    187,  
    195,  
    203,  
    211,  
    219,  
    227  
]  
},  
{  
    "globalOperatingClass": 133,  
    "channelCfi": [  
        7,
```

```
        23,
        39,
        55,
        71,
        87,
        103,
        119,
        135,
        151,
        167,
        183,
        199,
        215
    ]
},
{
    "globalOperatingClass": 134,
    "channelCfi": [
        15,
        47,
        79,
        111,
        143,
        175,
        207
    ]
}
],
"vendorExtensions": [
    {
        "extensionId": "APInfo",
        "parameters": {
            "version": "v1",
            "PID": "CW9166D1-B",
            "countryCode": "US "
        }
    }
]
```

```
    ]
  }
],
"vendorExtensions": [
  {
    "extensionId": "XEControllerInfo",
    "parameters": {
      "version": "v1",
      "extendedDebugEnable": "False",
      "chassisInfo": [
        {
          "role": "active",
          "PID": "C9800-L-C-K9",
          "SN": "FCL2649004F"
        }
      ],
      "licenseInfo": {
        "licensingType": "air-dna-advantage",
        "count": 1,
        "lastRumAckReceived": "<none>",
        "countAPsRequiringAFC": 1
      }
    }
  }
]
}
```

2023-09-21T03:15:11Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
```

```
{
  "channelCfi": [
    33,
    37,
    41,
    45,
    49,
    53,
    57,
    61
  ],
  "globalOperatingClass": 131,
  "maxEirp": [
    28.190853115113875,
    31.85332932717362,
    21.565571854598335,
    32.821260897842265,
    26.74378120107636,
    26.17626787716448,
    34.54797075316358,
    27.279490804038183
  ]
},
{
  "channelCfi": [
    35,
    43,
    51,
    59
  ],
  "globalOperatingClass": 132,
  "maxEirp": [
    31.201153071753687,
    24.575871811238148,
    29.186567833804293,
    30.289790760677995
  ]
}
```

```
    },
    {
      "channelCfi": [
        39,
        55
      ],
      "globalOperatingClass": 133,
      "maxEirp": [
        27.586171767877957,
        32.1968677904441
      ]
    },
    {
      "channelCfi": [
        47
      ],
      "globalOperatingClass": 134,
      "maxEirp": [
        30.596471724517773
      ]
    }
  ],
  "requestId": "17789456456611047435",
  "availabilityExpireTime": "2023-09-22T03:15:11Z",
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}
```

CT_AFC_SP_AP_AFCDUAU34_Channel_10624_1

2023-09-21T03:44:55Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Accept-Encoding": "deflate, gzip",
    "Content-Type": "application/json",
    "X-Forwarded-For": "192.100.100.254",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "1702",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "17789456456611047436",
        "deviceDescriptor": {
          "serialNumber": "KWC271505S8",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "longitude": -121.91889,
          "latitude": 37.416858
        },
        "majorAxis": 25,
        "minorAxis": 25,
        "orientation": 0.0
      }
    }
  }
}
```

```
    },
    "elevation": {
      "height": 15,
      "heightType": "AGL",
      "verticalUncertainty": 5
    },
    "indoorDeployment": 1
  },
  "inquiredChannels": [
    {
      "globalOperatingClass": 131,
      "channelCfi": [
        1,
        5,
        9,
        13,
        17,
        21,
        25,
        29,
        33,
        37,
        41,
        45,
        49,
        53,
        57,
        61,
        65,
        69,
        73,
        77,
        81,
        85,
        89,
        93,
        97,
```



```
101,  
105,  
109,  
113,  
117,  
121,  
125,  
129,  
133,  
137,  
141,  
145,  
149,  
153,  
157,  
161,  
165,  
169,  
173,  
177,  
181,  
185,  
189,  
193,  
197,  
201,  
205,  
209,  
213,  
217,  
221,  
225,  
229,  
233  
]  
,  
{
```

```
"globalOperatingClass": 132,  
"channelCfi": [  
    3,  
    11,  
    19,  
    27,  
    35,  
    43,  
    51,  
    59,  
    67,  
    75,  
    83,  
    91,  
    99,  
    107,  
    115,  
    123,  
    131,  
    139,  
    147,  
    155,  
    163,  
    171,  
    179,  
    187,  
    195,  
    203,  
    211,  
    219,  
    227  
]  
},  
{  
    "globalOperatingClass": 133,  
    "channelCfi": [  
        7,
```

```
        23,
        39,
        55,
        71,
        87,
        103,
        119,
        135,
        151,
        167,
        183,
        199,
        215
    ]
},
{
    "globalOperatingClass": 134,
    "channelCfi": [
        15,
        47,
        79,
        111,
        143,
        175,
        207
    ]
}
],
"vendorExtensions": [
    {
        "extensionId": "APInfo",
        "parameters": {
            "version": "v1",
            "PID": "CW9166D1-B",
            "countryCode": "US "
        }
    }
]
```

```
    ]
  }
],
"vendorExtensions": [
  {
    "extensionId": "XEControllerInfo",
    "parameters": {
      "version": "v1",
      "extendedDebugEnable": "False",
      "chassisInfo": [
        {
          "role": "active",
          "PID": "C9800-L-C-K9",
          "SN": "FCL2649004F"
        }
      ],
      "licenseInfo": {
        "licensingType": "air-dna-advantage",
        "count": 1,
        "lastRumAckReceived": "<none>",
        "countAPsRequiringAFC": 1
      }
    }
  }
]
}
```

2023-09-21T03:44:55Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableChannelInfo": [
```

```
{  
  "channelCfi": [  
    1,  
    5,  
    9,  
    13,  
    17,  
    21,  
    25,  
    29,  
    33,  
    37,  
    41,  
    45,  
    49,  
    53,  
    57,  
    61,  
    65,  
    69,  
    73,  
    77,  
    81,  
    85,  
    89,  
    93,  
    117,  
    121,  
    125,  
    129,  
    133,  
    137,  
    141,  
    145,  
    149,  
    153,  
    157,
```

[illegible]

```
36.0,  
36.0,  
36.0,  
36.0,  
36.0,  
36.0,  
36.0,  
36.0,  
36.0,  
36.0,  
36.0,  
36.0,  
36.0  
]  
,  
{  
  "channelCfi": [  
    3,  
    11,  
    19,  
    27,  
    35,  
    43,  
    51,  
    59,  
    67,  
    75,  
    83,  
    91,  
    123,  
    131,  
    139,  
    147,  
    155,  
    163,  
    171,  
    179
```

```

],
"globalOperatingClass": 132,
"maxEirp": [
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0
]
},
{
    "channelCfi": [
        7,
        23,
        39,
        55,
        71,
        87,
        135,
        151,
        167
    ],

```



```
"globalOperatingClass": 133,
  "maxEirp": [
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0,
    36.0
  ]
},
{
  "channelCfi": [
    15,
    47,
    79,
    143
  ],
  "globalOperatingClass": 134,
  "maxEirp": [
    36.0,
    36.0,
    36.0,
    36.0
  ]
}
],
"requestId": "17789456456611047436",
"availabilityExpireTime": "2023-09-22T03:44:55Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}
```

AFC capability - Inquired Frequency**CT_AFC_SP_AP_AFCDRSA31_Frequency_20MHz_10611_1**

2023-09-28T20:49:37Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
```

```
        "minorAxis": 20,
        "orientation": 0
    },
    "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9166D1"
        }
    }
]
},
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
```

```
    }
  }

##### 2023-09-28T20:49:37Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 6605,
            "lowFrequency": 6585
          },
          "maxPsd": 15.810874329666753
        },
        {
          "frequencyRange": {
            "highFrequency": 6625,
            "lowFrequency": 6605
          },
          "maxPsd": 11.465418416318542
        },
        {
          "frequencyRange": {
            "highFrequency": 6645,
            "lowFrequency": 6625
          },
          "maxPsd": 16.549806287668773
        },
        {
          "frequencyRange": {
            "highFrequency": 6665,
            "lowFrequency": 6645
          }
        }
      ]
    }
  ]
}
```

```
    },
    "maxPsd": 8.473007726235991
  },
  {
    "frequencyRange": {
      "highFrequency": 6685,
      "lowFrequency": 6665
    },
    "maxPsd": 10.503527864414144
  },
  {
    "frequencyRange": {
      "highFrequency": 6705,
      "lowFrequency": 6685
    },
    "maxPsd": 15.176428675053529
  },
  {
    "frequencyRange": {
      "highFrequency": 6725,
      "lowFrequency": 6705
    },
    "maxPsd": 11.511820326188285
  },
  {
    "frequencyRange": {
      "highFrequency": 6745,
      "lowFrequency": 6725
    },
    "maxPsd": 15.873129673390213
  }
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T20:49:37Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
```

```
],
```

```
"version": "1.4"
}

##### 2023-09-28T20:49:38Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
```

```
        "minorAxis": 20,
        "orientation": 0
    },
    "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9166D1"
        }
    }
]
},
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
```

```
}
}

##### 2023-09-28T20:49:38Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 6605,
            "lowFrequency": 6585
          },
          "maxPsd": 15.810874329666753
        },
        {
          "frequencyRange": {
            "highFrequency": 6625,
            "lowFrequency": 6605
          },
          "maxPsd": 11.465418416318542
        },
        {
          "frequencyRange": {
            "highFrequency": 6645,
            "lowFrequency": 6625
          },
          "maxPsd": 16.549806287668773
        },
        {
          "frequencyRange": {
            "highFrequency": 6665,
            "lowFrequency": 6645
          }
        }
      ]
    }
  ]
}
```



```
    },
    "maxPsd": 8.473007726235991
  },
  {
    "frequencyRange": {
      "highFrequency": 6685,
      "lowFrequency": 6665
    },
    "maxPsd": 10.503527864414144
  },
  {
    "frequencyRange": {
      "highFrequency": 6705,
      "lowFrequency": 6685
    },
    "maxPsd": 15.176428675053529
  },
  {
    "frequencyRange": {
      "highFrequency": 6725,
      "lowFrequency": 6705
    },
    "maxPsd": 11.511820326188285
  },
  {
    "frequencyRange": {
      "highFrequency": 6745,
      "lowFrequency": 6725
    },
    "maxPsd": 15.873129673390213
  }
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T20:49:38Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
```

```
],
```

```
"version": "1.4"
}

##### 2023-09-28T20:54:41Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        }
      }
    }
  }
}
```

```
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
    },
    "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9166D1"
        }
    }
]
},
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
```

```
    ]
  }
}

##### 2023-09-28T20:54:42Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 5965,
            "lowFrequency": 5945
          },
          "maxPsd": 21.242826415320206
        },
        {
          "frequencyRange": {
            "highFrequency": 5985,
            "lowFrequency": 5965
          },
          "maxPsd": 18.252962770852385
        },
        {
          "frequencyRange": {
            "highFrequency": 6005,
            "lowFrequency": 5985
          },
          "maxPsd": 8.33448130244512
        },
        {
          "frequencyRange": {
            "highFrequency": 6025,
```

```
        "lowFrequency": 6005
      },
      "maxPsd": 16.88238733542324
    },
    {
      "frequencyRange": {
        "highFrequency": 6045,
        "lowFrequency": 6025
      },
      "maxPsd": 21.80624854831089
    },
    {
      "frequencyRange": {
        "highFrequency": 6065,
        "lowFrequency": 6045
      },
      "maxPsd": 8.568832761444982
    },
    {
      "frequencyRange": {
        "highFrequency": 6085,
        "lowFrequency": 6065
      },
      "maxPsd": 10.491539949503606
    },
    {
      "frequencyRange": {
        "highFrequency": 6105,
        "lowFrequency": 6085
      },
      "maxPsd": 15.2642662820368
    },
    {
      "frequencyRange": {
        "highFrequency": 6125,
        "lowFrequency": 6105
      },
    },
```

```
"maxPsd": 9.580055182842814
},
{
  "frequencyRange": {
    "highFrequency": 6145,
    "lowFrequency": 6125
  },
  "maxPsd": 19.91553691832207
},
{
  "frequencyRange": {
    "highFrequency": 6165,
    "lowFrequency": 6145
  },
  "maxPsd": 11.923015940298082
},
{
  "frequencyRange": {
    "highFrequency": 6185,
    "lowFrequency": 6165
  },
  "maxPsd": 11.403580248786543
},
{
  "frequencyRange": {
    "highFrequency": 6205,
    "lowFrequency": 6185
  },
  "maxPsd": 18.17808348297421
},
{
  "frequencyRange": {
    "highFrequency": 6225,
    "lowFrequency": 6205
  },
  "maxPsd": 8.125196184725127
},
},
```

```
{
  "frequencyRange": {
    "highFrequency": 6245,
    "lowFrequency": 6225
  },
  "maxPsd": 19.199347833633226
},
{
  "frequencyRange": {
    "highFrequency": 6265,
    "lowFrequency": 6245
  },
  "maxPsd": 18.086961185626368
},
{
  "frequencyRange": {
    "highFrequency": 6285,
    "lowFrequency": 6265
  },
  "maxPsd": 17.530171344962632
},
{
  "frequencyRange": {
    "highFrequency": 6305,
    "lowFrequency": 6285
  },
  "maxPsd": 14.165468136920474
},
{
  "frequencyRange": {
    "highFrequency": 6325,
    "lowFrequency": 6305
  },
  "maxPsd": 13.077364203531467
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6345,
        "lowFrequency": 6325
    },
    "maxPsd": 10.84919856634902
},
{
    "frequencyRange": {
        "highFrequency": 6365,
        "lowFrequency": 6345
    },
    "maxPsd": 9.365952157408435
},
{
    "frequencyRange": {
        "highFrequency": 6385,
        "lowFrequency": 6365
    },
    "maxPsd": 16.713445819709683
},
{
    "frequencyRange": {
        "highFrequency": 6405,
        "lowFrequency": 6385
    },
    "maxPsd": 15.2410325973611
},
{
    "frequencyRange": {
        "highFrequency": 6425,
        "lowFrequency": 6405
    },
    "maxPsd": 21.82122337446888
}
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T20:54:41Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
```



```
}  
],  
"version": "1.4"  
}
```

```
##### 2023-09-28T20:54:42Z #####
```

```
{  
  "headers": {  
    "Host": "testserver.wfatestorg.org",  
    "Accept": "/*/*",  
    "Content-Type": "application/json",  
    "X-Forwarded-For": "209.206.53.23",  
    "X-Forwarded-Host": "testserver.wfatestorg.org",  
    "X-Forwarded-Server": "testserver.wfatestorg.org",  
    "Content-Length": "726",  
    "Connection": "Keep-Alive"  
  },  
  "body": {  
    "version": "1.4",  
    "availableSpectrumInquiryRequests": [  
      {  
        "requestId": "114665199316912",  
        "deviceDescriptor": {  
          "serialNumber": "Q5AG-EBKF-5MV4",  
          "certificationId": [  
            {  
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",  
              "nra": "FCC",  
              "id": "LDK-9160S2579"  
            }  
          ]  
        }  
      ]  
    },  
    "location": {  
      "ellipse": {  
        "center": {  
          "latitude": 38,  
          "longitude": -122
```

```
        },
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
    },
    "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9166D1"
        }
    }
]
}
],
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
```

```
}
]
}
}

##### 2023-09-28T20:54:42Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 5965,
            "lowFrequency": 5945
          },
          "maxPsd": 21.242826415320206
        },
        {
          "frequencyRange": {
            "highFrequency": 5985,
            "lowFrequency": 5965
          },
          "maxPsd": 18.252962770852385
        },
        {
          "frequencyRange": {
            "highFrequency": 6005,
            "lowFrequency": 5985
          },
          "maxPsd": 8.33448130244512
        },
        {
          "frequencyRange": {
```

```
        "highFrequency": 6025,
        "lowFrequency": 6005
    },
    "maxPsd": 16.88238733542324
},
{
    "frequencyRange": {
        "highFrequency": 6045,
        "lowFrequency": 6025
    },
    "maxPsd": 21.80624854831089
},
{
    "frequencyRange": {
        "highFrequency": 6065,
        "lowFrequency": 6045
    },
    "maxPsd": 8.568832761444982
},
{
    "frequencyRange": {
        "highFrequency": 6085,
        "lowFrequency": 6065
    },
    "maxPsd": 10.491539949503606
},
{
    "frequencyRange": {
        "highFrequency": 6105,
        "lowFrequency": 6085
    },
    "maxPsd": 15.2642662820368
},
{
    "frequencyRange": {
        "highFrequency": 6125,
        "lowFrequency": 6105
```

```
    },
    "maxPsd": 9.580055182842814
  },
  {
    "frequencyRange": {
      "highFrequency": 6145,
      "lowFrequency": 6125
    },
    "maxPsd": 19.91553691832207
  },
  {
    "frequencyRange": {
      "highFrequency": 6165,
      "lowFrequency": 6145
    },
    "maxPsd": 11.923015940298082
  },
  {
    "frequencyRange": {
      "highFrequency": 6185,
      "lowFrequency": 6165
    },
    "maxPsd": 11.403580248786543
  },
  {
    "frequencyRange": {
      "highFrequency": 6205,
      "lowFrequency": 6185
    },
    "maxPsd": 18.17808348297421
  },
  {
    "frequencyRange": {
      "highFrequency": 6225,
      "lowFrequency": 6205
    },
    "maxPsd": 8.125196184725127
  }
```

```
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6245,  
        "lowFrequency": 6225  
      },  
      "maxPsd": 19.199347833633226  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6265,  
        "lowFrequency": 6245  
      },  
      "maxPsd": 18.086961185626368  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6285,  
        "lowFrequency": 6265  
      },  
      "maxPsd": 17.530171344962632  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6305,  
        "lowFrequency": 6285  
      },  
      "maxPsd": 14.165468136920474  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6325,  
        "lowFrequency": 6305  
      },  
      "maxPsd": 13.077364203531467  
    },  
    {
```

```
"frequencyRange": {
  "highFrequency": 6345,
  "lowFrequency": 6325
},
"maxPsd": 10.84919856634902
},
{
  "frequencyRange": {
    "highFrequency": 6365,
    "lowFrequency": 6345
  },
  "maxPsd": 9.365952157408435
},
{
  "frequencyRange": {
    "highFrequency": 6385,
    "lowFrequency": 6365
  },
  "maxPsd": 16.713445819709683
},
{
  "frequencyRange": {
    "highFrequency": 6405,
    "lowFrequency": 6385
  },
  "maxPsd": 15.2410325973611
},
{
  "frequencyRange": {
    "highFrequency": 6425,
    "lowFrequency": 6405
  },
  "maxPsd": 21.82122337446888
}
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T20:54:42Z",
```



```
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"  
  }  
],  
  "version": "1.4"  
}
```


CT_AFC_SP_AP_AFCDSA31_Frequency_40MHz_10612_1

2023-09-28T21:06:08Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        },
        "location": {
          "ellipse": {
            "center": {
              "latitude": 38,
              "longitude": -122
            },
            "majorAxis": 20,
            "minorAxis": 20,
```

```
        "orientation": 0
      },
      "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
      },
      "indoorDeployment": 1
    },
    "inquiredFrequencyRange": [
      {
        "lowFrequency": 5945,
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "CW9166D1"
        }
      }
    ]
  },
  "vendorExtensions": [
    {
      "extensionId": "CiscoInfo",
      "parameters": {
        "version": "1.4",
        "source": "Cloud",
        "identity": 1003
      }
    }
  ]
}
```

```
}

##### 2023-09-28T21:06:08Z #####

{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 5965,
            "lowFrequency": 5945
          },
          "maxPsd": 16.832728957864195
        },
        {
          "frequencyRange": {
            "highFrequency": 5985,
            "lowFrequency": 5965
          },
          "maxPsd": 14.319576159680542
        },
        {
          "frequencyRange": {
            "highFrequency": 6005,
            "lowFrequency": 5985
          },
          "maxPsd": 14.206373210150797
        }
      ]
    }
  ]
}
```

```
"maxPsd": 14.527007093774461
},
{
  "frequencyRange": {
    "highFrequency": 6045,
    "lowFrequency": 6025
  },
  "maxPsd": 21.664474653052398
},
{
  "frequencyRange": {
    "highFrequency": 6065,
    "lowFrequency": 6045
  },
  "maxPsd": 8.615550360878567
},
{
  "frequencyRange": {
    "highFrequency": 6085,
    "lowFrequency": 6065
  },
  "maxPsd": 8.56094448316879
},
{
  "frequencyRange": {
    "highFrequency": 6105,
    "lowFrequency": 6085
  },
  "maxPsd": 20.369572045267173
},
{
  "frequencyRange": {
    "highFrequency": 6125,
    "lowFrequency": 6105
  },
  "maxPsd": 20.37823124020163
},
},
```

```
{
  "frequencyRange": {
    "highFrequency": 6145,
    "lowFrequency": 6125
  },
  "maxPsd": 14.815316155751361
},
{
  "frequencyRange": {
    "highFrequency": 6165,
    "lowFrequency": 6145
  },
  "maxPsd": 12.563089401360457
},
{
  "frequencyRange": {
    "highFrequency": 6185,
    "lowFrequency": 6165
  },
  "maxPsd": 19.00770919673764
},
{
  "frequencyRange": {
    "highFrequency": 6205,
    "lowFrequency": 6185
  },
  "maxPsd": 9.8700919260632
},
{
  "frequencyRange": {
    "highFrequency": 6225,
    "lowFrequency": 6205
  },
  "maxPsd": 21.887408727946287
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6245,
        "lowFrequency": 6225
      },
      "maxPsd": 12.584418289518553
    },
    {
      "frequencyRange": {
        "highFrequency": 6265,
        "lowFrequency": 6245
      },
      "maxPsd": 18.699419830483333
    }
  ],
  "requestId": "114665199316912",
  "availabilityExpireTime": "2023-09-29T21:06:08Z",
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}

],
"version": "1.4"
}

##### 2023-09-28T21:06:08Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
```

```
"requestId": "114665199316912",
"deviceDescriptor": {
  "serialNumber": "Q5AG-EBKF-5MV4",
  "certificationId": [
    {
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
      "nra": "FCC",
      "id": "LDK-9160S2579"
    }
  ]
},
"location": {
  "ellipse": {
    "center": {
      "latitude": 38,
      "longitude": -122
    },
    "majorAxis": 20,
    "minorAxis": 20,
    "orientation": 0
  },
  "elevation": {
    "height": 10.0,
    "heightType": "AGL",
    "verticalUncertainty": 10.0
  },
  "indoorDeployment": 1
},
"inquiredFrequencyRange": [
  {
    "lowFrequency": 5945,
    "highFrequency": 6875
  }
],
"vendorExtensions": [
  {
    "extensionId": "CiscoApInfo",
```

```
        "parameters": {
            "version": "1.4",
            "PID": "CW9166D1"
        }
    }
]
}
],
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
}
}
```

2023-09-28T21:06:09Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 5965,
            "lowFrequency": 5945
          },
          "maxPsd": 16.832728957864195
        }
      ]
    }
  ]
}
```



```
{
  "frequencyRange": {
    "highFrequency": 5985,
    "lowFrequency": 5965
  },
  "maxPsd": 14.319576159680542
},
{
  "frequencyRange": {
    "highFrequency": 6005,
    "lowFrequency": 5985
  },
  "maxPsd": 14.206373210150797
},
{
  "frequencyRange": {
    "highFrequency": 6025,
    "lowFrequency": 6005
  },
  "maxPsd": 14.527007093774461
},
{
  "frequencyRange": {
    "highFrequency": 6045,
    "lowFrequency": 6025
  },
  "maxPsd": 21.664474653052398
},
{
  "frequencyRange": {
    "highFrequency": 6065,
    "lowFrequency": 6045
  },
  "maxPsd": 8.615550360878567
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6085,
        "lowFrequency": 6065
    },
    "maxPsd": 8.56094448316879
},
{
    "frequencyRange": {
        "highFrequency": 6105,
        "lowFrequency": 6085
    },
    "maxPsd": 20.369572045267173
},
{
    "frequencyRange": {
        "highFrequency": 6125,
        "lowFrequency": 6105
    },
    "maxPsd": 20.37823124020163
},
{
    "frequencyRange": {
        "highFrequency": 6145,
        "lowFrequency": 6125
    },
    "maxPsd": 14.815316155751361
},
{
    "frequencyRange": {
        "highFrequency": 6165,
        "lowFrequency": 6145
    },
    "maxPsd": 12.563089401360457
},
{
    "frequencyRange": {
        "highFrequency": 6185,
        "lowFrequency": 6165
```

```
    },
    "maxPsd": 19.00770919673764
  },
  {
    "frequencyRange": {
      "highFrequency": 6205,
      "lowFrequency": 6185
    },
    "maxPsd": 9.8700919260632
  },
  {
    "frequencyRange": {
      "highFrequency": 6225,
      "lowFrequency": 6205
    },
    "maxPsd": 21.887408727946287
  },
  {
    "frequencyRange": {
      "highFrequency": 6245,
      "lowFrequency": 6225
    },
    "maxPsd": 12.584418289518553
  },
  {
    "frequencyRange": {
      "highFrequency": 6265,
      "lowFrequency": 6245
    },
    "maxPsd": 18.699419830483333
  }
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T21:06:08Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
```

```
],
```

```
"version": "1.4"
}

##### 2023-09-28T21:11:24Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        }
      }
    }
  }
}
```

```
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
    },
    "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9166D1"
        }
    }
]
},
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
```

```
    ]
  }
}

##### 2023-09-28T21:11:24Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 6285,
            "lowFrequency": 6265
          },
          "maxPsd": 13.587250646522161
        },
        {
          "frequencyRange": {
            "highFrequency": 6305,
            "lowFrequency": 6285
          },
          "maxPsd": 9.827652440023192
        },
        {
          "frequencyRange": {
            "highFrequency": 6325,
            "lowFrequency": 6305
          },
          "maxPsd": 15.107923120452167
        },
        {
          "frequencyRange": {
            "highFrequency": 6345,
```

```
        "lowFrequency": 6325
      },
      "maxPsd": 14.158508718276881
    },
    {
      "frequencyRange": {
        "highFrequency": 6365,
        "lowFrequency": 6345
      },
      "maxPsd": 17.143828727693453
    },
    {
      "frequencyRange": {
        "highFrequency": 6385,
        "lowFrequency": 6365
      },
      "maxPsd": 20.216767866980234
    },
    {
      "frequencyRange": {
        "highFrequency": 6405,
        "lowFrequency": 6385
      },
      "maxPsd": 17.72227222440534
    },
    {
      "frequencyRange": {
        "highFrequency": 6425,
        "lowFrequency": 6405
      },
      "maxPsd": 11.195386493727824
    },
    {
      "frequencyRange": {
        "highFrequency": 6605,
        "lowFrequency": 6585
      },
    },
```

```
"maxPsd": 19.504654751918864
},
{
  "frequencyRange": {
    "highFrequency": 6625,
    "lowFrequency": 6605
  },
  "maxPsd": 20.733992335387235
},
{
  "frequencyRange": {
    "highFrequency": 6645,
    "lowFrequency": 6625
  },
  "maxPsd": 9.383320186216054
},
{
  "frequencyRange": {
    "highFrequency": 6665,
    "lowFrequency": 6645
  },
  "maxPsd": 14.625914281157037
},
{
  "frequencyRange": {
    "highFrequency": 6685,
    "lowFrequency": 6665
  },
  "maxPsd": 15.65999770034129
},
{
  "frequencyRange": {
    "highFrequency": 6705,
    "lowFrequency": 6685
  },
  "maxPsd": 13.27419386242741
},
},
```



```
{
  "frequencyRange": {
    "highFrequency": 6725,
    "lowFrequency": 6705
  },
  "maxPsd": 9.056815118673883
},
{
  "frequencyRange": {
    "highFrequency": 6745,
    "lowFrequency": 6725
  },
  "maxPsd": 21.950862019257258
}
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T21:11:24Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2023-09-28T21:11:25Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
```

```
"availableSpectrumInquiryRequests": [  
  {  
    "requestId": "114665199316912",  
    "deviceDescriptor": {  
      "serialNumber": "Q5AG-EBKF-5MV4",  
      "certificationId": [  
        {  
          "rulesetId": "US_47_CFR_PART_15_SUBPART_E",  
          "nra": "FCC",  
          "id": "LDK-9160S2579"  
        }  
      ]  
    },  
    "location": {  
      "ellipse": {  
        "center": {  
          "latitude": 38,  
          "longitude": -122  
        },  
        "majorAxis": 20,  
        "minorAxis": 20,  
        "orientation": 0  
      },  
      "elevation": {  
        "height": 10.0,  
        "heightType": "AGL",  
        "verticalUncertainty": 10.0  
      },  
      "indoorDeployment": 1  
    },  
    "inquiredFrequencyRange": [  
      {  
        "lowFrequency": 5945,  
        "highFrequency": 6875  
      }  
    ],  
    "vendorExtensions": [  
      {  
        "frequency": 5945,  
        "power": 10,  
        "type": "F",  
        "width": 10  
      },  
      {  
        "frequency": 6875,  
        "power": 10,  
        "type": "F",  
        "width": 10  
      }  
    ]  
  }  
]
```

```
{
  "extensionId": "CiscoApInfo",
  "parameters": {
    "version": "1.4",
    "PID": "CW9166D1"
  }
}
],
"vendorExtensions": [
  {
    "extensionId": "CiscoInfo",
    "parameters": {
      "version": "1.4",
      "source": "Cloud",
      "identity": 1003
    }
  }
]
}
}

##### 2023-09-28T21:11:25Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 6285,
            "lowFrequency": 6265
          },
        },
      ],
    }
  ],
}
```

```
"maxPsd": 13.587250646522161
},
{
  "frequencyRange": {
    "highFrequency": 6305,
    "lowFrequency": 6285
  },
  "maxPsd": 9.827652440023192
},
{
  "frequencyRange": {
    "highFrequency": 6325,
    "lowFrequency": 6305
  },
  "maxPsd": 15.107923120452167
},
{
  "frequencyRange": {
    "highFrequency": 6345,
    "lowFrequency": 6325
  },
  "maxPsd": 14.158508718276881
},
{
  "frequencyRange": {
    "highFrequency": 6365,
    "lowFrequency": 6345
  },
  "maxPsd": 17.143828727693453
},
{
  "frequencyRange": {
    "highFrequency": 6385,
    "lowFrequency": 6365
  },
  "maxPsd": 20.216767866980234
},
},
```

```
{
  "frequencyRange": {
    "highFrequency": 6405,
    "lowFrequency": 6385
  },
  "maxPsd": 17.72227222440534
},
{
  "frequencyRange": {
    "highFrequency": 6425,
    "lowFrequency": 6405
  },
  "maxPsd": 11.195386493727824
},
{
  "frequencyRange": {
    "highFrequency": 6605,
    "lowFrequency": 6585
  },
  "maxPsd": 19.504654751918864
},
{
  "frequencyRange": {
    "highFrequency": 6625,
    "lowFrequency": 6605
  },
  "maxPsd": 20.733992335387235
},
{
  "frequencyRange": {
    "highFrequency": 6645,
    "lowFrequency": 6625
  },
  "maxPsd": 9.383320186216054
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6665,
        "lowFrequency": 6645
    },
    "maxPsd": 14.625914281157037
},
{
    "frequencyRange": {
        "highFrequency": 6685,
        "lowFrequency": 6665
    },
    "maxPsd": 15.65999770034129
},
{
    "frequencyRange": {
        "highFrequency": 6705,
        "lowFrequency": 6685
    },
    "maxPsd": 13.27419386242741
},
{
    "frequencyRange": {
        "highFrequency": 6725,
        "lowFrequency": 6705
    },
    "maxPsd": 9.056815118673883
},
{
    "frequencyRange": {
        "highFrequency": 6745,
        "lowFrequency": 6725
    },
    "maxPsd": 21.950862019257258
}
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T21:11:25Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
```



```
}  
],  
"version": "1.4"  
}
```

CT_AFC_SP_AP_AFCRSA31_Frequency_80MHz_10613_1

2023-10-04T06:37:39Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
        "minorAxis": 20,

```



```
        "orientation": 0
      },
      "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
      },
      "indoorDeployment": 1
    },
    "inquiredFrequencyRange": [
      {
        "lowFrequency": 5945,
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "CW9166D1"
        }
      }
    ]
  },
  "vendorExtensions": [
    {
      "extensionId": "CiscoInfo",
      "parameters": {
        "version": "1.4",
        "source": "Cloud",
        "identity": 1003
      }
    }
  ]
}
```

```
}

##### 2023-10-04T06:37:39Z #####

{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 6125,
            "lowFrequency": 6105
          },
          "maxPsd": 21.788266855966878
        },
        {
          "frequencyRange": {
            "highFrequency": 6145,
            "lowFrequency": 6125
          },
          "maxPsd": 13.206501570875838
        },
        {
          "frequencyRange": {
            "highFrequency": 6165,
            "lowFrequency": 6145
          },
          "maxPsd": 13.682483993204988
        }
      ]
    }
  ]
}
```

```
"maxPsd": 10.742513220238635
},
{
  "frequencyRange": {
    "highFrequency": 6205,
    "lowFrequency": 6185
  },
  "maxPsd": 19.463885604813292
},
{
  "frequencyRange": {
    "highFrequency": 6225,
    "lowFrequency": 6205
  },
  "maxPsd": 19.30912265990147
},
{
  "frequencyRange": {
    "highFrequency": 6245,
    "lowFrequency": 6225
  },
  "maxPsd": 14.258102962105209
},
{
  "frequencyRange": {
    "highFrequency": 6265,
    "lowFrequency": 6245
  },
  "maxPsd": 12.749148182979914
},
{
  "frequencyRange": {
    "highFrequency": 6285,
    "lowFrequency": 6265
  },
  "maxPsd": 10.487338225488344
},
},
```

```
{
  "frequencyRange": {
    "highFrequency": 6305,
    "lowFrequency": 6285
  },
  "maxPsd": 9.814765188839681
},
{
  "frequencyRange": {
    "highFrequency": 6325,
    "lowFrequency": 6305
  },
  "maxPsd": 10.2475930869205
},
{
  "frequencyRange": {
    "highFrequency": 6345,
    "lowFrequency": 6325
  },
  "maxPsd": 21.38016942773618
},
{
  "frequencyRange": {
    "highFrequency": 6365,
    "lowFrequency": 6345
  },
  "maxPsd": 8.239337739563933
},
{
  "frequencyRange": {
    "highFrequency": 6385,
    "lowFrequency": 6365
  },
  "maxPsd": 19.519679386686242
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6405,
        "lowFrequency": 6385
    },
    "maxPsd": 19.499513725877723
},
{
    "frequencyRange": {
        "highFrequency": 6425,
        "lowFrequency": 6405
    },
    "maxPsd": 15.39851576801277
},
{
    "frequencyRange": {
        "highFrequency": 6605,
        "lowFrequency": 6585
    },
    "maxPsd": 15.616946983187004
},
{
    "frequencyRange": {
        "highFrequency": 6625,
        "lowFrequency": 6605
    },
    "maxPsd": 18.22449916521297
},
{
    "frequencyRange": {
        "highFrequency": 6645,
        "lowFrequency": 6625
    },
    "maxPsd": 20.78443322345526
},
{
    "frequencyRange": {
        "highFrequency": 6665,
        "lowFrequency": 6645
```

```
    },
    "maxPsd": 15.045367247926919
  },
  {
    "frequencyRange": {
      "highFrequency": 6685,
      "lowFrequency": 6665
    },
    "maxPsd": 20.566402674626364
  },
  {
    "frequencyRange": {
      "highFrequency": 6705,
      "lowFrequency": 6685
    },
    "maxPsd": 17.209254695307592
  },
  {
    "frequencyRange": {
      "highFrequency": 6725,
      "lowFrequency": 6705
    },
    "maxPsd": 21.97411604664807
  },
  {
    "frequencyRange": {
      "highFrequency": 6745,
      "lowFrequency": 6725
    },
    "maxPsd": 12.295703411348832
  }
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-10-05T06:37:39Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
```

```
],
```

```
"version": "1.4"
}

##### 2023-10-04T06:37:40Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
```

```
        "minorAxis": 20,
        "orientation": 0
    },
    "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9166D1"
        }
    }
]
},
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
```



```
}
}

##### 2023-10-04T06:37:40Z #####

{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 6125,
            "lowFrequency": 6105
          },
          "maxPsd": 21.788266855966878
        },
        {
          "frequencyRange": {
            "highFrequency": 6145,
            "lowFrequency": 6125
          },
          "maxPsd": 13.206501570875838
        },
        {
          "frequencyRange": {
            "highFrequency": 6165,
            "lowFrequency": 6145
          },
          "maxPsd": 13.682483993204988
        },
        {
          "frequencyRange": {
            "highFrequency": 6185,
            "lowFrequency": 6165
          }
        }
      ]
    }
  ]
}
```

```
    },
    "maxPsd": 10.742513220238635
  },
  {
    "frequencyRange": {
      "highFrequency": 6205,
      "lowFrequency": 6185
    },
    "maxPsd": 19.463885604813292
  },
  {
    "frequencyRange": {
      "highFrequency": 6225,
      "lowFrequency": 6205
    },
    "maxPsd": 19.30912265990147
  },
  {
    "frequencyRange": {
      "highFrequency": 6245,
      "lowFrequency": 6225
    },
    "maxPsd": 14.258102962105209
  },
  {
    "frequencyRange": {
      "highFrequency": 6265,
      "lowFrequency": 6245
    },
    "maxPsd": 12.749148182979914
  },
  {
    "frequencyRange": {
      "highFrequency": 6285,
      "lowFrequency": 6265
    },
    "maxPsd": 10.487338225488344
  }
```



```
"frequencyRange": {
  "highFrequency": 6405,
  "lowFrequency": 6385
},
"maxPsd": 19.499513725877723
},
{
  "frequencyRange": {
    "highFrequency": 6425,
    "lowFrequency": 6405
  },
  "maxPsd": 15.39851576801277
},
{
  "frequencyRange": {
    "highFrequency": 6605,
    "lowFrequency": 6585
  },
  "maxPsd": 15.616946983187004
},
{
  "frequencyRange": {
    "highFrequency": 6625,
    "lowFrequency": 6605
  },
  "maxPsd": 18.22449916521297
},
{
  "frequencyRange": {
    "highFrequency": 6645,
    "lowFrequency": 6625
  },
  "maxPsd": 20.78443322345526
},
{
  "frequencyRange": {
    "highFrequency": 6665,
```

```
        "lowFrequency": 6645
      },
      "maxPsd": 15.045367247926919
    },
    {
      "frequencyRange": {
        "highFrequency": 6685,
        "lowFrequency": 6665
      },
      "maxPsd": 20.566402674626364
    },
    {
      "frequencyRange": {
        "highFrequency": 6705,
        "lowFrequency": 6685
      },
      "maxPsd": 17.209254695307592
    },
    {
      "frequencyRange": {
        "highFrequency": 6725,
        "lowFrequency": 6705
      },
      "maxPsd": 21.97411604664807
    },
    {
      "frequencyRange": {
        "highFrequency": 6745,
        "lowFrequency": 6725
      },
      "maxPsd": 12.295703411348832
    }
  ],
  "requestId": "114665199316912",
  "availabilityExpireTime": "2023-10-05T06:37:40Z",
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
```

```
    ],
    "version": "1.4"
  }

##### 2023-10-04T06:51:52Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "725",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "216425118749712",
        "deviceDescriptor": {
          "serialNumber": "Q5AL-8KLB-NDBQ",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2578"
            }
          ]
        }
      },
      {
        "location": {
          "ellipse": {
            "center": {
              "latitude": 38,
              "longitude": -122
            }
          }
        }
      }
    ]
  }
}
```

```
    },
    "majorAxis": 20,
    "minorAxis": 20,
    "orientation": 0
  },
  "elevation": {
    "height": 33.0,
    "heightType": "AGL",
    "verticalUncertainty": 10.0
  },
  "indoorDeployment": 1
},
"inquiredFrequencyRange": [
  {
    "lowFrequency": 5945,
    "highFrequency": 6875
  }
],
"vendorExtensions": [
  {
    "extensionId": "CiscoApInfo",
    "parameters": {
      "version": "1.4",
      "PID": "CW9164I"
    }
  }
]
}
],
"vendorExtensions": [
  {
    "extensionId": "CiscoInfo",
    "parameters": {
      "version": "1.4",
      "source": "Cloud",
      "identity": 1003
    }
  }
]
```

```
}  
]  
}  
}
```

2023-10-04T06:51:52Z

```
{  
  "availableSpectrumInquiryResponses": [  
    {  
      "response": {  
        "responseCode": 0,  
        "shortDescription": "SUCCESS"  
      },  
      "availableFrequencyInfo": [  
        {  
          "frequencyRange": {  
            "highFrequency": 5965,  
            "lowFrequency": 5945  
          },  
          "maxPsd": 11.817265029250745  
        },  
        {  
          "frequencyRange": {  
            "highFrequency": 5985,  
            "lowFrequency": 5965  
          },  
          "maxPsd": 14.889713513030916  
        },  
        {  
          "frequencyRange": {  
            "highFrequency": 6005,  
            "lowFrequency": 5985  
          },  
          "maxPsd": 15.348141981258488  
        },  
        {  
          "frequencyRange": {
```



```
        "highFrequency": 6025,
        "lowFrequency": 6005
    },
    "maxPsd": 14.137844371068432
},
{
    "frequencyRange": {
        "highFrequency": 6045,
        "lowFrequency": 6025
    },
    "maxPsd": 9.673430120226474
},
{
    "frequencyRange": {
        "highFrequency": 6065,
        "lowFrequency": 6045
    },
    "maxPsd": 11.128997344313976
},
{
    "frequencyRange": {
        "highFrequency": 6085,
        "lowFrequency": 6065
    },
    "maxPsd": 18.296885956282544
},
{
    "frequencyRange": {
        "highFrequency": 6105,
        "lowFrequency": 6085
    },
    "maxPsd": 19.861364745206473
}
],
"requestId": "216425118749712",
"availabilityExpireTime": "2023-10-05T06:51:52Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
```

```
}  
],  
"version": "1.4"  
}
```

2023-10-04T06:51:53Z

```
{  
  "headers": {  
    "Host": "testserver.wfatestorg.org",  
    "Accept": "/*/*",  
    "Content-Type": "application/json",  
    "X-Forwarded-For": "209.206.53.23",  
    "X-Forwarded-Host": "testserver.wfatestorg.org",  
    "X-Forwarded-Server": "testserver.wfatestorg.org",  
    "Content-Length": "725",  
    "Connection": "Keep-Alive"  
  },  
  "body": {  
    "version": "1.4",  
    "availableSpectrumInquiryRequests": [  
      {  
        "requestId": "216425118749712",  
        "deviceDescriptor": {  
          "serialNumber": "Q5AL-8KLB-NDBQ",  
          "certificationId": [  
            {  
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",  
              "nra": "FCC",  
              "id": "LDK-9160S2578"  
            }  
          ]  
        }  
      ],  
      {  
        "location": {  
          "ellipse": {  
            "center": {  
              "latitude": 38,  
              "longitude": -122
```

```
    },
    "majorAxis": 20,
    "minorAxis": 20,
    "orientation": 0
  },
  "elevation": {
    "height": 33.0,
    "heightType": "AGL",
    "verticalUncertainty": 10.0
  },
  "indoorDeployment": 1
},
"inquiredFrequencyRange": [
  {
    "lowFrequency": 5945,
    "highFrequency": 6875
  }
],
"vendorExtensions": [
  {
    "extensionId": "CiscoApInfo",
    "parameters": {
      "version": "1.4",
      "PID": "CW9164I"
    }
  }
]
}
],
"vendorExtensions": [
  {
    "extensionId": "CiscoInfo",
    "parameters": {
      "version": "1.4",
      "source": "Cloud",
      "identity": 1003
    }
  }
]
```

```
}  
]  
}  
}
```

2023-10-04T06:51:53Z

```
{  
  "availableSpectrumInquiryResponses": [  
    {  
      "response": {  
        "responseCode": 0,  
        "shortDescription": "SUCCESS"  
      },  
      "availableFrequencyInfo": [  
        {  
          "frequencyRange": {  
            "highFrequency": 5965,  
            "lowFrequency": 5945  
          },  
          "maxPsd": 11.817265029250745  
        },  
        {  
          "frequencyRange": {  
            "highFrequency": 5985,  
            "lowFrequency": 5965  
          },  
          "maxPsd": 14.889713513030916  
        },  
        {  
          "frequencyRange": {  
            "highFrequency": 6005,  
            "lowFrequency": 5985  
          },  
          "maxPsd": 15.348141981258488  
        },  
        {  
          "frequencyRange": {
```

```
        "highFrequency": 6025,
        "lowFrequency": 6005
    },
    "maxPsd": 14.137844371068432
},
{
    "frequencyRange": {
        "highFrequency": 6045,
        "lowFrequency": 6025
    },
    "maxPsd": 9.673430120226474
},
{
    "frequencyRange": {
        "highFrequency": 6065,
        "lowFrequency": 6045
    },
    "maxPsd": 11.128997344313976
},
{
    "frequencyRange": {
        "highFrequency": 6085,
        "lowFrequency": 6065
    },
    "maxPsd": 18.296885956282544
},
{
    "frequencyRange": {
        "highFrequency": 6105,
        "lowFrequency": 6085
    },
    "maxPsd": 19.861364745206473
}
],
"requestId": "216425118749712",
"availabilityExpireTime": "2023-10-05T06:51:53Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
```

```
    }
  ],
  "version": "1.4"
}

##### 2023-10-04T06:52:10Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        },
        "location": {
          "ellipse": {
            "center": {
              "latitude": 38,
```

```
        "longitude": -122
      },
      "majorAxis": 20,
      "minorAxis": 20,
      "orientation": 0
    },
    "elevation": {
      "height": 10.0,
      "heightType": "AGL",
      "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
  },
  "inquiredFrequencyRange": [
    {
      "lowFrequency": 5945,
      "highFrequency": 6875
    }
  ],
  "vendorExtensions": [
    {
      "extensionId": "CiscoApInfo",
      "parameters": {
        "version": "1.4",
        "PID": "CW9166D1"
      }
    }
  ]
},
"vendorExtensions": [
  {
    "extensionId": "CiscoInfo",
    "parameters": {
      "version": "1.4",
      "source": "Cloud",
      "identity": 1003
    }
  }
]
```

```
    }
  }
]
}
}

##### 2023-10-04T06:52:10Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 5965,
            "lowFrequency": 5945
          },
          "maxPsd": 11.817265029250745
        },
        {
          "frequencyRange": {
            "highFrequency": 5985,
            "lowFrequency": 5965
          },
          "maxPsd": 14.889713513030916
        },
        {
          "frequencyRange": {
            "highFrequency": 6005,
            "lowFrequency": 5985
          },
          "maxPsd": 15.348141981258488
        }
      ]
    }
  ]
}
```



```
"frequencyRange": {
  "highFrequency": 6025,
  "lowFrequency": 6005
},
"maxPsd": 14.137844371068432
},
{
  "frequencyRange": {
    "highFrequency": 6045,
    "lowFrequency": 6025
  },
  "maxPsd": 9.673430120226474
},
{
  "frequencyRange": {
    "highFrequency": 6065,
    "lowFrequency": 6045
  },
  "maxPsd": 11.128997344313976
},
{
  "frequencyRange": {
    "highFrequency": 6085,
    "lowFrequency": 6065
  },
  "maxPsd": 18.296885956282544
},
{
  "frequencyRange": {
    "highFrequency": 6105,
    "lowFrequency": 6085
  },
  "maxPsd": 19.861364745206473
}
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-10-05T06:52:10Z",
```

```
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2023-10-04T06:52:11Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
```

```
        "longitude": -122
      },
      "majorAxis": 20,
      "minorAxis": 20,
      "orientation": 0
    },
    "elevation": {
      "height": 10.0,
      "heightType": "AGL",
      "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
  },
  "inquiredFrequencyRange": [
    {
      "lowFrequency": 5945,
      "highFrequency": 6875
    }
  ],
  "vendorExtensions": [
    {
      "extensionId": "CiscoApInfo",
      "parameters": {
        "version": "1.4",
        "PID": "CW9166D1"
      }
    }
  ]
},
"vendorExtensions": [
  {
    "extensionId": "CiscoInfo",
    "parameters": {
      "version": "1.4",
      "source": "Cloud",
      "identity": 1003
    }
  }
]
```

```
    }
  }
]
}
}

##### 2023-10-04T06:52:11Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 5965,
            "lowFrequency": 5945
          },
          "maxPsd": 11.817265029250745
        },
        {
          "frequencyRange": {
            "highFrequency": 5985,
            "lowFrequency": 5965
          },
          "maxPsd": 14.889713513030916
        },
        {
          "frequencyRange": {
            "highFrequency": 6005,
            "lowFrequency": 5985
          },
          "maxPsd": 15.348141981258488
        }
      ]
    }
  ]
}
```

```
        "frequencyRange": {
            "highFrequency": 6025,
            "lowFrequency": 6005
        },
        "maxPsd": 14.137844371068432
    },
    {
        "frequencyRange": {
            "highFrequency": 6045,
            "lowFrequency": 6025
        },
        "maxPsd": 9.673430120226474
    },
    {
        "frequencyRange": {
            "highFrequency": 6065,
            "lowFrequency": 6045
        },
        "maxPsd": 11.128997344313976
    },
    {
        "frequencyRange": {
            "highFrequency": 6085,
            "lowFrequency": 6065
        },
        "maxPsd": 18.296885956282544
    },
    {
        "frequencyRange": {
            "highFrequency": 6105,
            "lowFrequency": 6085
        },
        "maxPsd": 19.861364745206473
    }
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-10-05T06:52:11Z",
```



```
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"  
  }  
],  
  "version": "1.4"  
}
```

CT_AFC_SP_AP_AFCDSA31_Frequency_160MHz_10614_1

2023-09-28T21:57:25Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
        "minorAxis": 20,

```

```
        "orientation": 0
      },
      "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
      },
      "indoorDeployment": 1
    },
    "inquiredFrequencyRange": [
      {
        "lowFrequency": 5945,
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "CW9166D1"
        }
      }
    ]
  },
  "vendorExtensions": [
    {
      "extensionId": "CiscoInfo",
      "parameters": {
        "version": "1.4",
        "source": "Cloud",
        "identity": 1003
      }
    }
  ]
}
```



```
}

##### 2023-09-28T21:57:25Z #####

{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 5965,
            "lowFrequency": 5945
          },
          "maxPsd": 20.929046472573877
        },
        {
          "frequencyRange": {
            "highFrequency": 5985,
            "lowFrequency": 5965
          },
          "maxPsd": 16.66222824172576
        },
        {
          "frequencyRange": {
            "highFrequency": 6005,
            "lowFrequency": 5985
          },
          "maxPsd": 21.484213376959836
        },
        {
          "frequencyRange": {
            "highFrequency": 6025,
            "lowFrequency": 6005
          },

```

```
"maxPsd": 9.110626976982621
},
{
  "frequencyRange": {
    "highFrequency": 6045,
    "lowFrequency": 6025
  },
  "maxPsd": 10.590576788018549
},
{
  "frequencyRange": {
    "highFrequency": 6065,
    "lowFrequency": 6045
  },
  "maxPsd": 16.337890483147874
},
{
  "frequencyRange": {
    "highFrequency": 6085,
    "lowFrequency": 6065
  },
  "maxPsd": 17.66977557470075
},
{
  "frequencyRange": {
    "highFrequency": 6105,
    "lowFrequency": 6085
  },
  "maxPsd": 8.319359167903224
},
{
  "frequencyRange": {
    "highFrequency": 6285,
    "lowFrequency": 6265
  },
  "maxPsd": 12.055166451188711
},
},
```

```
{
  "frequencyRange": {
    "highFrequency": 6305,
    "lowFrequency": 6285
  },
  "maxPsd": 10.798343263086212
},
{
  "frequencyRange": {
    "highFrequency": 6325,
    "lowFrequency": 6305
  },
  "maxPsd": 14.893241761060668
},
{
  "frequencyRange": {
    "highFrequency": 6345,
    "lowFrequency": 6325
  },
  "maxPsd": 21.803957018794023
},
{
  "frequencyRange": {
    "highFrequency": 6365,
    "lowFrequency": 6345
  },
  "maxPsd": 20.548015254088874
},
{
  "frequencyRange": {
    "highFrequency": 6385,
    "lowFrequency": 6365
  },
  "maxPsd": 19.657673867561805
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6405,
        "lowFrequency": 6385
      },
      "maxPsd": 14.625248450067945
    },
    {
      "frequencyRange": {
        "highFrequency": 6425,
        "lowFrequency": 6405
      },
      "maxPsd": 13.181808506616736
    }
  ],
  "requestId": "114665199316912",
  "availabilityExpireTime": "2023-09-29T21:57:25Z",
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}

],
"version": "1.4"
}

##### 2023-09-28T21:57:26Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
```

```
"requestId": "114665199316912",
"deviceDescriptor": {
  "serialNumber": "Q5AG-EBKF-5MV4",
  "certificationId": [
    {
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
      "nra": "FCC",
      "id": "LDK-9160S2579"
    }
  ]
},
"location": {
  "ellipse": {
    "center": {
      "latitude": 38,
      "longitude": -122
    },
    "majorAxis": 20,
    "minorAxis": 20,
    "orientation": 0
  },
  "elevation": {
    "height": 10.0,
    "heightType": "AGL",
    "verticalUncertainty": 10.0
  },
  "indoorDeployment": 1
},
"inquiredFrequencyRange": [
  {
    "lowFrequency": 5945,
    "highFrequency": 6875
  }
],
"vendorExtensions": [
  {
    "extensionId": "CiscoApInfo",
```

```
        "parameters": {
            "version": "1.4",
            "PID": "CW9166D1"
        }
    }
]
},
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
}
}
```

2023-09-28T21:57:26Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 5965,
            "lowFrequency": 5945
          },
          "maxPsd": 20.929046472573877
        }
      ]
    }
  ]
}
```

```
{
  "frequencyRange": {
    "highFrequency": 5985,
    "lowFrequency": 5965
  },
  "maxPsd": 16.66222824172576
},
{
  "frequencyRange": {
    "highFrequency": 6005,
    "lowFrequency": 5985
  },
  "maxPsd": 21.484213376959836
},
{
  "frequencyRange": {
    "highFrequency": 6025,
    "lowFrequency": 6005
  },
  "maxPsd": 9.110626976982621
},
{
  "frequencyRange": {
    "highFrequency": 6045,
    "lowFrequency": 6025
  },
  "maxPsd": 10.590576788018549
},
{
  "frequencyRange": {
    "highFrequency": 6065,
    "lowFrequency": 6045
  },
  "maxPsd": 16.337890483147874
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6085,
        "lowFrequency": 6065
    },
    "maxPsd": 17.66977557470075
},
{
    "frequencyRange": {
        "highFrequency": 6105,
        "lowFrequency": 6085
    },
    "maxPsd": 8.319359167903224
},
{
    "frequencyRange": {
        "highFrequency": 6285,
        "lowFrequency": 6265
    },
    "maxPsd": 12.055166451188711
},
{
    "frequencyRange": {
        "highFrequency": 6305,
        "lowFrequency": 6285
    },
    "maxPsd": 10.798343263086212
},
{
    "frequencyRange": {
        "highFrequency": 6325,
        "lowFrequency": 6305
    },
    "maxPsd": 14.893241761060668
},
{
    "frequencyRange": {
        "highFrequency": 6345,
        "lowFrequency": 6325
```



```
    },
    "maxPsd": 21.803957018794023
  },
  {
    "frequencyRange": {
      "highFrequency": 6365,
      "lowFrequency": 6345
    },
    "maxPsd": 20.548015254088874
  },
  {
    "frequencyRange": {
      "highFrequency": 6385,
      "lowFrequency": 6365
    },
    "maxPsd": 19.657673867561805
  },
  {
    "frequencyRange": {
      "highFrequency": 6405,
      "lowFrequency": 6385
    },
    "maxPsd": 14.625248450067945
  },
  {
    "frequencyRange": {
      "highFrequency": 6425,
      "lowFrequency": 6405
    },
    "maxPsd": 13.181808506616736
  }
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T21:57:26Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
```

```
"version": "1.4"
}

##### 2023-09-28T22:02:05Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        }
      }
    }
  }
}
```

```
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
    },
    "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9166D1"
        }
    }
]
},
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
```

```
    ]
  }
}

##### 2023-09-28T22:02:05Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 6125,
            "lowFrequency": 6105
          },
          "maxPsd": 21.787929593803767
        },
        {
          "frequencyRange": {
            "highFrequency": 6145,
            "lowFrequency": 6125
          },
          "maxPsd": 8.82901561124943
        },
        {
          "frequencyRange": {
            "highFrequency": 6165,
            "lowFrequency": 6145
          },
          "maxPsd": 9.73087160906458
        },
        {
          "frequencyRange": {
            "highFrequency": 6185,
```

```
        "lowFrequency": 6165
      },
      "maxPsd": 10.610142622160616
    },
    {
      "frequencyRange": {
        "highFrequency": 6205,
        "lowFrequency": 6185
      },
      "maxPsd": 10.671166373503596
    },
    {
      "frequencyRange": {
        "highFrequency": 6225,
        "lowFrequency": 6205
      },
      "maxPsd": 17.60170666668352
    },
    {
      "frequencyRange": {
        "highFrequency": 6245,
        "lowFrequency": 6225
      },
      "maxPsd": 19.93773240169294
    },
    {
      "frequencyRange": {
        "highFrequency": 6265,
        "lowFrequency": 6245
      },
      "maxPsd": 20.206039828621634
    },
    {
      "frequencyRange": {
        "highFrequency": 6605,
        "lowFrequency": 6585
      },
    },
```

```
"maxPsd": 10.303979186894912
},
{
  "frequencyRange": {
    "highFrequency": 6625,
    "lowFrequency": 6605
  },
  "maxPsd": 9.036839481551056
},
{
  "frequencyRange": {
    "highFrequency": 6645,
    "lowFrequency": 6625
  },
  "maxPsd": 16.191460593947376
},
{
  "frequencyRange": {
    "highFrequency": 6665,
    "lowFrequency": 6645
  },
  "maxPsd": 19.837930410350985
},
{
  "frequencyRange": {
    "highFrequency": 6685,
    "lowFrequency": 6665
  },
  "maxPsd": 8.964410022277404
},
{
  "frequencyRange": {
    "highFrequency": 6705,
    "lowFrequency": 6685
  },
  "maxPsd": 9.594719096007413
},
},
```

```
{
  "frequencyRange": {
    "highFrequency": 6725,
    "lowFrequency": 6705
  },
  "maxPsd": 17.31731543500946
},
{
  "frequencyRange": {
    "highFrequency": 6745,
    "lowFrequency": 6725
  },
  "maxPsd": 15.455803482901153
}
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T22:02:05Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2023-09-28T22:02:06Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
```

```
"availableSpectrumInquiryRequests": [
  {
    "requestId": "114665199316912",
    "deviceDescriptor": {
      "serialNumber": "Q5AG-EBKF-5MV4",
      "certificationId": [
        {
          "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
          "nra": "FCC",
          "id": "LDK-9160S2579"
        }
      ]
    },
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
      },
      "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
      },
      "indoorDeployment": 1
    },
    "inquiredFrequencyRange": [
      {
        "lowFrequency": 5945,
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
```



```
{
  "extensionId": "CiscoApInfo",
  "parameters": {
    "version": "1.4",
    "PID": "CW9166D1"
  }
}
],
"vendorExtensions": [
  {
    "extensionId": "CiscoInfo",
    "parameters": {
      "version": "1.4",
      "source": "Cloud",
      "identity": 1003
    }
  }
]
}
}

##### 2023-09-28T22:02:06Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 6125,
            "lowFrequency": 6105
          },

```

```
"maxPsd": 21.787929593803767
},
{
  "frequencyRange": {
    "highFrequency": 6145,
    "lowFrequency": 6125
  },
  "maxPsd": 8.82901561124943
},
{
  "frequencyRange": {
    "highFrequency": 6165,
    "lowFrequency": 6145
  },
  "maxPsd": 9.73087160906458
},
{
  "frequencyRange": {
    "highFrequency": 6185,
    "lowFrequency": 6165
  },
  "maxPsd": 10.610142622160616
},
{
  "frequencyRange": {
    "highFrequency": 6205,
    "lowFrequency": 6185
  },
  "maxPsd": 10.671166373503596
},
{
  "frequencyRange": {
    "highFrequency": 6225,
    "lowFrequency": 6205
  },
  "maxPsd": 17.60170666668352
},
},
```

```
{
  "frequencyRange": {
    "highFrequency": 6245,
    "lowFrequency": 6225
  },
  "maxPsd": 19.93773240169294
},
{
  "frequencyRange": {
    "highFrequency": 6265,
    "lowFrequency": 6245
  },
  "maxPsd": 20.206039828621634
},
{
  "frequencyRange": {
    "highFrequency": 6605,
    "lowFrequency": 6585
  },
  "maxPsd": 10.303979186894912
},
{
  "frequencyRange": {
    "highFrequency": 6625,
    "lowFrequency": 6605
  },
  "maxPsd": 9.036839481551056
},
{
  "frequencyRange": {
    "highFrequency": 6645,
    "lowFrequency": 6625
  },
  "maxPsd": 16.191460593947376
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6665,
        "lowFrequency": 6645
    },
    "maxPsd": 19.837930410350985
},
{
    "frequencyRange": {
        "highFrequency": 6685,
        "lowFrequency": 6665
    },
    "maxPsd": 8.964410022277404
},
{
    "frequencyRange": {
        "highFrequency": 6705,
        "lowFrequency": 6685
    },
    "maxPsd": 9.594719096007413
},
{
    "frequencyRange": {
        "highFrequency": 6725,
        "lowFrequency": 6705
    },
    "maxPsd": 17.31731543500946
},
{
    "frequencyRange": {
        "highFrequency": 6745,
        "lowFrequency": 6725
    },
    "maxPsd": 15.455803482901153
}
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T22:02:06Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
```



```
}  
],  
"version": "1.4"  
}
```

CT_AFC_SP_AP_AFCDUSA32_Frequency_10615_1

2023-09-28T22:09:00Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Expect": "100-continue",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "2958",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "224971442307872",
        "deviceDescriptor": {
          "serialNumber": "Q5AA-JR8E-A8AK",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "UDX-600155010"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
```

```
        "minorAxis": 20,
        "orientation": 0
    },
    "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9162I"
        }
    }
]
},
{
    "requestId": "114665199316912",
    "deviceDescriptor": {
        "serialNumber": "Q5AG-EBKF-5MV4",
        "certificationId": [
            {
                "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
                "nra": "FCC",
                "id": "LDK-9160S2579"
            }
        ]
    }
}
```

```
    },
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
      },
      "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
      },
      "indoorDeployment": 1
    },
    "inquiredFrequencyRange": [
      {
        "lowFrequency": 5945,
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "CW9166D1"
        }
      }
    ]
  },
  {
    "requestId": "185021235223728",
    "deviceDescriptor": {
```



```
"serialNumber": "Q3AP-Z55W-D638",
"certificationId": [
  {
    "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
    "nra": "FCC",
    "id": "UDX-600104010"
  }
]
},
"location": {
  "ellipse": {
    "center": {
      "latitude": 38,
      "longitude": -122
    },
    "majorAxis": 20,
    "minorAxis": 20,
    "orientation": 0
  },
  "elevation": {
    "height": 33.0,
    "heightType": "AGL",
    "verticalUncertainty": 10.0
  },
  "indoorDeployment": 1
},
"inquiredFrequencyRange": [
  {
    "lowFrequency": 5945,
    "highFrequency": 6875
  }
],
"vendorExtensions": [
  {
    "extensionId": "CiscoApInfo",
    "parameters": {
      "version": "1.4",
```

```
        "PID": "MR57-HW"
      }
    }
  ]
},
{
  "requestId": "216425118749712",
  "deviceDescriptor": {
    "serialNumber": "Q5AL-8KLB-NDBQ",
    "certificationId": [
      {
        "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
        "nra": "FCC",
        "id": "LDK-9160S2578"
      }
    ]
  },
  "location": {
    "ellipse": {
      "center": {
        "latitude": 38,
        "longitude": -122
      },
      "majorAxis": 20,
      "minorAxis": 20,
      "orientation": 0
    },
    "elevation": {
      "height": 33.0,
      "heightType": "AGL",
      "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
  },
  "inquiredFrequencyRange": [
    {
      "lowFrequency": 5945,
```

```
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "CW9164I"
        }
      }
    ]
  },
  {
    "requestId": "224971443191696",
    "deviceDescriptor": {
      "serialNumber": "Q5AF-92V3-WRBA",
      "certificationId": [
        {
          "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
          "nra": "FCC",
          "id": "LDK-9160S2578"
        }
      ]
    },
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
      },
      "elevation": {
        "height": 10.0,
```

```
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9166I"
        }
    }
]
},
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
}
}
```

2023-09-28T22:09:00Z

{

```
"availableSpectrumInquiryResponses": [
  {
    "response": {
      "responseCode": 0,
      "shortDescription": "SUCCESS"
    },
    "availableFrequencyInfo": [],
    "availableChannelInfo": [],
    "requestId": "224971442307872",
    "availabilityExpireTime": "2023-09-29T22:09:00Z",
    "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
  }
],
"version": "1.4"
}

##### 2023-09-28T22:09:01Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Expect": "100-continue",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "2958",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "224971442307872",
        "deviceDescriptor": {
          "serialNumber": "Q5AA-JR8E-A8AK",
          "certificationId": [
```

```
{
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
  "nra": "FCC",
  "id": "UDX-600155010"
}
],
"location": {
  "ellipse": {
    "center": {
      "latitude": 38,
      "longitude": -122
    },
    "majorAxis": 20,
    "minorAxis": 20,
    "orientation": 0
  },
  "elevation": {
    "height": 10.0,
    "heightType": "AGL",
    "verticalUncertainty": 10.0
  },
  "indoorDeployment": 1
},
"inquiredFrequencyRange": [
  {
    "lowFrequency": 5945,
    "highFrequency": 6875
  }
],
"vendorExtensions": [
  {
    "extensionId": "CiscoApInfo",
    "parameters": {
      "version": "1.4",
      "PID": "CW9162I"
    }
  }
]
```

```
    }
  ]
},
{
  "requestId": "114665199316912",
  "deviceDescriptor": {
    "serialNumber": "Q5AG-EBKF-5MV4",
    "certificationId": [
      {
        "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
        "nra": "FCC",
        "id": "LDK-9160S2579"
      }
    ]
  },
  "location": {
    "ellipse": {
      "center": {
        "latitude": 38,
        "longitude": -122
      },
      "majorAxis": 20,
      "minorAxis": 20,
      "orientation": 0
    },
    "elevation": {
      "height": 10.0,
      "heightType": "AGL",
      "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
  },
  "inquiredFrequencyRange": [
    {
      "lowFrequency": 5945,
      "highFrequency": 6875
    }
  ]
}
```

```
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "CW9166D1"
        }
      }
    ]
  },
  {
    "requestId": "185021235223728",
    "deviceDescriptor": {
      "serialNumber": "Q3AP-Z55W-D638",
      "certificationId": [
        {
          "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
          "nra": "FCC",
          "id": "UDX-600104010"
        }
      ]
    },
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
      },
      "elevation": {
        "height": 33.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
      }
    }
  }
}
```



```
    },
    "indoorDeployment": 1
  },
  "inquiredFrequencyRange": [
    {
      "lowFrequency": 5945,
      "highFrequency": 6875
    }
  ],
  "vendorExtensions": [
    {
      "extensionId": "CiscoApInfo",
      "parameters": {
        "version": "1.4",
        "PID": "MR57-HW"
      }
    }
  ]
},
{
  "requestId": "216425118749712",
  "deviceDescriptor": {
    "serialNumber": "Q5AL-8KLB-NDBQ",
    "certificationId": [
      {
        "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
        "nra": "FCC",
        "id": "LDK-9160S2578"
      }
    ]
  },
  "location": {
    "ellipse": {
      "center": {
        "latitude": 38,
        "longitude": -122
      },
    },
  },
}
```

```
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
    },
    "elevation": {
        "height": 33.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9164I"
        }
    }
]
},
{
    "requestId": "224971443191696",
    "deviceDescriptor": {
        "serialNumber": "Q5AF-92V3-WRBA",
        "certificationId": [
            {
                "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
                "nra": "FCC",
                "id": "LDK-9160S2578"
            }
        ]
    }
}
```

```
    ]
  },
  "location": {
    "ellipse": {
      "center": {
        "latitude": 38,
        "longitude": -122
      },
      "majorAxis": 20,
      "minorAxis": 20,
      "orientation": 0
    },
    "elevation": {
      "height": 10.0,
      "heightType": "AGL",
      "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
  },
  "inquiredFrequencyRange": [
    {
      "lowFrequency": 5945,
      "highFrequency": 6875
    }
  ],
  "vendorExtensions": [
    {
      "extensionId": "CiscoApInfo",
      "parameters": {
        "version": "1.4",
        "PID": "CW9166I"
      }
    }
  ]
},
"vendorExtensions": [
```

```
{
  "extensionId": "CiscoInfo",
  "parameters": {
    "version": "1.4",
    "source": "Cloud",
    "identity": 1003
  }
}
]
}
}

##### 2023-09-28T22:09:01Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [],
      "availableChannelInfo": [],
      "requestId": "224971442307872",
      "availabilityExpireTime": "2023-09-29T22:09:01Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}

##### 2023-09-28T22:11:08Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
```

```
"X-Forwarded-For": "209.206.53.23",
"X-Forwarded-Host": "testserver.wfatestorg.org",
"X-Forwarded-Server": "testserver.wfatestorg.org",
"Content-Length": "725",
"Connection": "Keep-Alive"
},
"body": {
  "version": "1.4",
  "availableSpectrumInquiryRequests": [
    {
      "requestId": "224971442307872",
      "deviceDescriptor": {
        "serialNumber": "Q5AA-JR8E-A8AK",
        "certificationId": [
          {
            "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
            "nra": "FCC",
            "id": "UDX-600155010"
          }
        ]
      }
    }
  ],
  "location": {
    "ellipse": {
      "center": {
        "latitude": 38,
        "longitude": -122
      },
      "majorAxis": 20,
      "minorAxis": 20,
      "orientation": 0
    },
    "elevation": {
      "height": 10.0,
      "heightType": "AGL",
      "verticalUncertainty": 10.0
    }
  },
  "indoorDeployment": 1
}
```

```
    },
    "inquiredFrequencyRange": [
      {
        "lowFrequency": 5945,
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "CW9162I"
        }
      }
    ]
  },
  "vendorExtensions": [
    {
      "extensionId": "CiscoInfo",
      "parameters": {
        "version": "1.4",
        "source": "Cloud",
        "identity": 1003
      }
    }
  ]
}
```

```
##### 2023-09-28T22:11:08Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
```

```
"shortDescription": "SUCCESS"
},
"availableFrequencyInfo": [],
"availableChannelInfo": [],
"requestId": "224971442307872",
"availabilityExpireTime": "2023-09-29T22:11:08Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
],
"version": "1.4"
}

##### 2023-09-28T22:11:08Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "725",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "224971442307872",
        "deviceDescriptor": {
          "serialNumber": "Q5AA-JR8E-A8AK",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "UDX-600155010"
            }
          ]
        }
      }
    ]
  }
}
```

```
    ]
  },
  "location": {
    "ellipse": {
      "center": {
        "latitude": 38,
        "longitude": -122
      },
      "majorAxis": 20,
      "minorAxis": 20,
      "orientation": 0
    },
    "elevation": {
      "height": 10.0,
      "heightType": "AGL",
      "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
  },
  "inquiredFrequencyRange": [
    {
      "lowFrequency": 5945,
      "highFrequency": 6875
    }
  ],
  "vendorExtensions": [
    {
      "extensionId": "CiscoApInfo",
      "parameters": {
        "version": "1.4",
        "PID": "CW9162I"
      }
    }
  ]
},
"vendorExtensions": [
```



```
{
  "extensionId": "CiscoInfo",
  "parameters": {
    "version": "1.4",
    "source": "Cloud",
    "identity": 1003
  }
}
]
}
}

##### 2023-09-28T22:11:09Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [],
      "availableChannelInfo": [],
      "requestId": "224971442307872",
      "availabilityExpireTime": "2023-09-29T22:11:08Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}

##### 2023-09-28T22:12:33Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
```

```
"X-Forwarded-For": "209.206.53.23",
"X-Forwarded-Host": "testserver.wfatestorg.org",
"X-Forwarded-Server": "testserver.wfatestorg.org",
"Content-Length": "726",
"Connection": "Keep-Alive"
},
"body": {
  "version": "1.4",
  "availableSpectrumInquiryRequests": [
    {
      "requestId": "114665199316912",
      "deviceDescriptor": {
        "serialNumber": "Q5AG-EBKF-5MV4",
        "certificationId": [
          {
            "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
            "nra": "FCC",
            "id": "LDK-9160S2579"
          }
        ]
      }
    }
  ],
  "location": {
    "ellipse": {
      "center": {
        "latitude": 38,
        "longitude": -122
      },
      "majorAxis": 20,
      "minorAxis": 20,
      "orientation": 0
    },
    "elevation": {
      "height": 10.0,
      "heightType": "AGL",
      "verticalUncertainty": 10.0
    }
  },
  "indoorDeployment": 1
}
```

```
    },
    "inquiredFrequencyRange": [
      {
        "lowFrequency": 5945,
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "CW9166D1"
        }
      }
    ]
  },
  "vendorExtensions": [
    {
      "extensionId": "CiscoInfo",
      "parameters": {
        "version": "1.4",
        "source": "Cloud",
        "identity": 1003
      }
    }
  ]
}
```

2023-09-28T22:12:33Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
```

```
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [],
      "requestId": "114665199316912",
      "availabilityExpireTime": "2023-09-29T22:12:33Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}

##### 2023-09-28T22:12:34Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ]
  }
}
```

```
    },
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
      },
      "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
      },
      "indoorDeployment": 1
    },
    "inquiredFrequencyRange": [
      {
        "lowFrequency": 5945,
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "CW9166D1"
        }
      }
    ]
  },
  "vendorExtensions": [
    {
```

```
"extensionId": "CiscoInfo",
"parameters": {
  "version": "1.4",
  "source": "Cloud",
  "identity": 1003
}
}
]
}
}

##### 2023-09-28T22:12:34Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [],
      "requestId": "114665199316912",
      "availabilityExpireTime": "2023-09-29T22:12:34Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}

##### 2023-09-28T22:13:11Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Expect": "100-continue",
    "X-Forwarded-For": "209.206.53.23",
```

```
"X-Forwarded-Host": "testserver.wfatestorg.org",
"X-Forwarded-Server": "testserver.wfatestorg.org",
"Content-Length": "1841",
"Connection": "Keep-Alive"
},
"body": {
  "version": "1.4",
  "availableSpectrumInquiryRequests": [
    {
      "requestId": "185021235223728",
      "deviceDescriptor": {
        "serialNumber": "Q3AP-Z55W-D638",
        "certificationId": [
          {
            "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
            "nra": "FCC",
            "id": "UDX-600104010"
          }
        ]
      }
    },
    {
      "location": {
        "ellipse": {
          "center": {
            "latitude": 38,
            "longitude": -122
          },
          "majorAxis": 20,
          "minorAxis": 20,
          "orientation": 0
        },
        "elevation": {
          "height": 33.0,
          "heightType": "AGL",
          "verticalUncertainty": 10.0
        },
        "indoorDeployment": 1
      }
    }
  ]
}
```

```
"inquiredFrequencyRange": [  
  {  
    "lowFrequency": 5945,  
    "highFrequency": 6875  
  }  
],  
"vendorExtensions": [  
  {  
    "extensionId": "CiscoApInfo",  
    "parameters": {  
      "version": "1.4",  
      "PID": "MR57-HW"  
    }  
  }  
]  
},  
{  
  "requestId": "216425118749712",  
  "deviceDescriptor": {  
    "serialNumber": "Q5AL-8KLB-NDBQ",  
    "certificationId": [  
      {  
        "rulesetId": "US_47_CFR_PART_15_SUBPART_E",  
        "nra": "FCC",  
        "id": "LDK-9160S2578"  
      }  
    ]  
  },  
  "location": {  
    "ellipse": {  
      "center": {  
        "latitude": 38,  
        "longitude": -122  
      },  
      "majorAxis": 20,  
      "minorAxis": 20,  
      "orientation": 0
```



```
    },
    "elevation": {
      "height": 33.0,
      "heightType": "AGL",
      "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
  },
  "inquiredFrequencyRange": [
    {
      "lowFrequency": 5945,
      "highFrequency": 6875
    }
  ],
  "vendorExtensions": [
    {
      "extensionId": "CiscoApInfo",
      "parameters": {
        "version": "1.4",
        "PID": "CW9164I"
      }
    }
  ]
},
{
  "requestId": "224971443191696",
  "deviceDescriptor": {
    "serialNumber": "Q5AF-92V3-WRBA",
    "certificationId": [
      {
        "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
        "nra": "FCC",
        "id": "LDK-9160S2578"
      }
    ]
  },
  "location": {
```

```
"ellipse": {
  "center": {
    "latitude": 38,
    "longitude": -122
  },
  "majorAxis": 20,
  "minorAxis": 20,
  "orientation": 0
},
"elevation": {
  "height": 10.0,
  "heightType": "AGL",
  "verticalUncertainty": 10.0
},
"indoorDeployment": 1
},
"inquiredFrequencyRange": [
  {
    "lowFrequency": 5945,
    "highFrequency": 6875
  }
],
"vendorExtensions": [
  {
    "extensionId": "CiscoApInfo",
    "parameters": {
      "version": "1.4",
      "PID": "CW9166I"
    }
  }
]
},
"vendorExtensions": [
  {
    "extensionId": "CiscoInfo",
    "parameters": {
```

```
        "version": "1.4",
        "source": "Cloud",
        "identity": 1003
    }
}
]
}
}

##### 2023-09-28T22:13:11Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [],
      "requestId": "185021235223728",
      "availabilityExpireTime": "2023-09-29T22:13:11Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}

##### 2023-09-28T22:13:12Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "Expect": "100-continue",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "1841",
```

```
"Connection": "Keep-Alive"
},
"body": {
  "version": "1.4",
  "availableSpectrumInquiryRequests": [
    {
      "requestId": "185021235223728",
      "deviceDescriptor": {
        "serialNumber": "Q3AP-Z55W-D638",
        "certificationId": [
          {
            "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
            "nra": "FCC",
            "id": "UDX-600104010"
          }
        ]
      }
    }
  ],
  "location": {
    "ellipse": {
      "center": {
        "latitude": 38,
        "longitude": -122
      },
      "majorAxis": 20,
      "minorAxis": 20,
      "orientation": 0
    },
    "elevation": {
      "height": 33.0,
      "heightType": "AGL",
      "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
  },
  "inquiredFrequencyRange": [
    {
      "lowFrequency": 5945,
```

```
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "MR57-HW"
        }
      }
    ]
  },
  {
    "requestId": "216425118749712",
    "deviceDescriptor": {
      "serialNumber": "Q5AL-8KLB-NDBQ",
      "certificationId": [
        {
          "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
          "nra": "FCC",
          "id": "LDK-9160S2578"
        }
      ]
    },
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
      },
      "elevation": {
        "height": 33.0,
```

```
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9164I"
        }
    }
]
},
{
    "requestId": "224971443191696",
    "deviceDescriptor": {
        "serialNumber": "Q5AF-92V3-WRBA",
        "certificationId": [
            {
                "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
                "nra": "FCC",
                "id": "LDK-9160S2578"
            }
        ]
    },
    "location": {
        "ellipse": {
            "center": {
                "latitude": 38,
```

```
        "longitude": -122
      },
      "majorAxis": 20,
      "minorAxis": 20,
      "orientation": 0
    },
    "elevation": {
      "height": 10.0,
      "heightType": "AGL",
      "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
  },
  "inquiredFrequencyRange": [
    {
      "lowFrequency": 5945,
      "highFrequency": 6875
    }
  ],
  "vendorExtensions": [
    {
      "extensionId": "CiscoApInfo",
      "parameters": {
        "version": "1.4",
        "PID": "CW9166I"
      }
    }
  ]
},
"vendorExtensions": [
  {
    "extensionId": "CiscoInfo",
    "parameters": {
      "version": "1.4",
      "source": "Cloud",
      "identity": 1003
    }
  }
]
```

```
    }
  }
]
}
}

##### 2023-09-28T22:13:12Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [],
      "requestId": "185021235223728",
      "availabilityExpireTime": "2023-09-29T22:13:12Z",
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}
```


CT_AFC_SP_AP_AFCDSAU33_Frequency_10616_1

2023-09-28T23:36:18Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
        "minorAxis": 20,
```

```
        "orientation": 0
      },
      "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
      },
      "indoorDeployment": 1
    },
    "inquiredFrequencyRange": [
      {
        "lowFrequency": 5945,
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "CW9166D1"
        }
      }
    ]
  },
  "vendorExtensions": [
    {
      "extensionId": "CiscoInfo",
      "parameters": {
        "version": "1.4",
        "source": "Cloud",
        "identity": 1003
      }
    }
  ]
}
```

```
}

##### 2023-09-28T23:36:18Z #####

{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 6285,
            "lowFrequency": 6265
          },
          "maxPsd": 14.762021600298533
        },
        {
          "frequencyRange": {
            "highFrequency": 6305,
            "lowFrequency": 6285
          },
          "maxPsd": 20.630817176615196
        },
        {
          "frequencyRange": {
            "highFrequency": 6325,
            "lowFrequency": 6305
          },
          "maxPsd": 21.170660620100655
        },
        {
          "frequencyRange": {
            "highFrequency": 6345,
            "lowFrequency": 6325
          },

```

```
"maxPsd": 12.326861546920654
},
{
  "frequencyRange": {
    "highFrequency": 6365,
    "lowFrequency": 6345
  },
  "maxPsd": 13.275280355676657
},
{
  "frequencyRange": {
    "highFrequency": 6385,
    "lowFrequency": 6365
  },
  "maxPsd": 9.162128418798515
},
{
  "frequencyRange": {
    "highFrequency": 6405,
    "lowFrequency": 6385
  },
  "maxPsd": 21.473345898567175
},
{
  "frequencyRange": {
    "highFrequency": 6425,
    "lowFrequency": 6405
  },
  "maxPsd": 21.103713783893
},
{
  "frequencyRange": {
    "highFrequency": 6605,
    "lowFrequency": 6585
  },
  "maxPsd": 17.634689811717827
},
},
```

```
{
  "frequencyRange": {
    "highFrequency": 6625,
    "lowFrequency": 6605
  },
  "maxPsd": 19.650603245344122
},
{
  "frequencyRange": {
    "highFrequency": 6645,
    "lowFrequency": 6625
  },
  "maxPsd": 11.73509016331579
},
{
  "frequencyRange": {
    "highFrequency": 6665,
    "lowFrequency": 6645
  },
  "maxPsd": 10.456324867382364
},
{
  "frequencyRange": {
    "highFrequency": 6685,
    "lowFrequency": 6665
  },
  "maxPsd": 11.471132529656192
},
{
  "frequencyRange": {
    "highFrequency": 6705,
    "lowFrequency": 6685
  },
  "maxPsd": 15.836639153046946
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6725,
        "lowFrequency": 6705
      },
      "maxPsd": 16.19548069782693
    },
    {
      "frequencyRange": {
        "highFrequency": 6745,
        "lowFrequency": 6725
      },
      "maxPsd": 8.810637164430526
    }
  ],
  "requestId": "114665199316912",
  "availabilityExpireTime": "2023-09-29T23:36:18Z",
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}

],
"version": "1.4"
}

##### 2023-09-28T23:36:19Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
```

```
"requestId": "114665199316912",
"deviceDescriptor": {
  "serialNumber": "Q5AG-EBKF-5MV4",
  "certificationId": [
    {
      "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
      "nra": "FCC",
      "id": "LDK-9160S2579"
    }
  ]
},
"location": {
  "ellipse": {
    "center": {
      "latitude": 38,
      "longitude": -122
    },
    "majorAxis": 20,
    "minorAxis": 20,
    "orientation": 0
  },
  "elevation": {
    "height": 10.0,
    "heightType": "AGL",
    "verticalUncertainty": 10.0
  },
  "indoorDeployment": 1
},
"inquiredFrequencyRange": [
  {
    "lowFrequency": 5945,
    "highFrequency": 6875
  }
],
"vendorExtensions": [
  {
    "extensionId": "CiscoApInfo",
```

```
        "parameters": {
            "version": "1.4",
            "PID": "CW9166D1"
        }
    }
]
},
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
}
}
```

2023-09-28T23:36:19Z

```
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 6285,
            "lowFrequency": 6265
          },
          "maxPsd": 14.762021600298533
        }
      ]
    }
  ]
}
```



```
{
  "frequencyRange": {
    "highFrequency": 6305,
    "lowFrequency": 6285
  },
  "maxPsd": 20.630817176615196
},
{
  "frequencyRange": {
    "highFrequency": 6325,
    "lowFrequency": 6305
  },
  "maxPsd": 21.170660620100655
},
{
  "frequencyRange": {
    "highFrequency": 6345,
    "lowFrequency": 6325
  },
  "maxPsd": 12.326861546920654
},
{
  "frequencyRange": {
    "highFrequency": 6365,
    "lowFrequency": 6345
  },
  "maxPsd": 13.275280355676657
},
{
  "frequencyRange": {
    "highFrequency": 6385,
    "lowFrequency": 6365
  },
  "maxPsd": 9.162128418798515
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6405,
        "lowFrequency": 6385
    },
    "maxPsd": 21.473345898567175
},
{
    "frequencyRange": {
        "highFrequency": 6425,
        "lowFrequency": 6405
    },
    "maxPsd": 21.103713783893
},
{
    "frequencyRange": {
        "highFrequency": 6605,
        "lowFrequency": 6585
    },
    "maxPsd": 17.634689811717827
},
{
    "frequencyRange": {
        "highFrequency": 6625,
        "lowFrequency": 6605
    },
    "maxPsd": 19.650603245344122
},
{
    "frequencyRange": {
        "highFrequency": 6645,
        "lowFrequency": 6625
    },
    "maxPsd": 11.73509016331579
},
{
    "frequencyRange": {
        "highFrequency": 6665,
        "lowFrequency": 6645
```

```
    },
    "maxPsd": 10.456324867382364
  },
  {
    "frequencyRange": {
      "highFrequency": 6685,
      "lowFrequency": 6665
    },
    "maxPsd": 11.471132529656192
  },
  {
    "frequencyRange": {
      "highFrequency": 6705,
      "lowFrequency": 6685
    },
    "maxPsd": 15.836639153046946
  },
  {
    "frequencyRange": {
      "highFrequency": 6725,
      "lowFrequency": 6705
    },
    "maxPsd": 16.19548069782693
  },
  {
    "frequencyRange": {
      "highFrequency": 6745,
      "lowFrequency": 6725
    },
    "maxPsd": 8.810637164430526
  }
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T23:36:19Z",
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
```



"version": "1.4"

}

CT_AFC_SP_AP_AFCDUUAU34_Frequency_10617_1

2023-09-28T22:43:46Z

```
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "User-Agent": "curl/7.68.0",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        },
        "majorAxis": 20,
        "minorAxis": 20,

```

```
        "orientation": 0
      },
      "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
      },
      "indoorDeployment": 1
    },
    "inquiredFrequencyRange": [
      {
        "lowFrequency": 5945,
        "highFrequency": 6875
      }
    ],
    "vendorExtensions": [
      {
        "extensionId": "CiscoApInfo",
        "parameters": {
          "version": "1.4",
          "PID": "CW9166D1"
        }
      }
    ]
  },
  "vendorExtensions": [
    {
      "extensionId": "CiscoInfo",
      "parameters": {
        "version": "1.4",
        "source": "Cloud",
        "identity": 1003
      }
    }
  ]
}
```

```
}

##### 2023-09-28T22:43:47Z #####

{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 5965,
            "lowFrequency": 5945
          },
          "maxPsd": 23
        },
        {
          "frequencyRange": {
            "highFrequency": 5985,
            "lowFrequency": 5965
          },
          "maxPsd": 23
        },
        {
          "frequencyRange": {
            "highFrequency": 6005,
            "lowFrequency": 5985
          },
          "maxPsd": 23
        },
        {
          "frequencyRange": {
            "highFrequency": 6025,
            "lowFrequency": 6005
          },

```

```
        "maxPsd": 23
    },
    {
        "frequencyRange": {
            "highFrequency": 6045,
            "lowFrequency": 6025
        },
        "maxPsd": 23
    },
    {
        "frequencyRange": {
            "highFrequency": 6065,
            "lowFrequency": 6045
        },
        "maxPsd": 23
    },
    {
        "frequencyRange": {
            "highFrequency": 6085,
            "lowFrequency": 6065
        },
        "maxPsd": 23
    },
    {
        "frequencyRange": {
            "highFrequency": 6105,
            "lowFrequency": 6085
        },
        "maxPsd": 23
    },
    {
        "frequencyRange": {
            "highFrequency": 6125,
            "lowFrequency": 6105
        },
        "maxPsd": 23
    },
    },
```



```
{
  "frequencyRange": {
    "highFrequency": 6145,
    "lowFrequency": 6125
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6165,
    "lowFrequency": 6145
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6185,
    "lowFrequency": 6165
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6205,
    "lowFrequency": 6185
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6245,
    "lowFrequency": 6225
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6265,
        "lowFrequency": 6245
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6285,
        "lowFrequency": 6265
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6305,
        "lowFrequency": 6285
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6325,
        "lowFrequency": 6305
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6345,
        "lowFrequency": 6325
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6365,
        "lowFrequency": 6345
```

```
    },  
    "maxPsd": 23  
  },  
  {  
    "frequencyRange": {  
      "highFrequency": 6385,  
      "lowFrequency": 6365  
    },  
    "maxPsd": 23  
  },  
  {  
    "frequencyRange": {  
      "highFrequency": 6405,  
      "lowFrequency": 6385  
    },  
    "maxPsd": 23  
  },  
  {  
    "frequencyRange": {  
      "highFrequency": 6425,  
      "lowFrequency": 6405  
    },  
    "maxPsd": 23  
  },  
  {  
    "frequencyRange": {  
      "highFrequency": 6545,  
      "lowFrequency": 6525  
    },  
    "maxPsd": 23  
  },  
  {  
    "frequencyRange": {  
      "highFrequency": 6565,  
      "lowFrequency": 6545  
    },  
    "maxPsd": 23  
  }
```

```
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6585,  
        "lowFrequency": 6565  
      },  
      "maxPsd": 23  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6605,  
        "lowFrequency": 6585  
      },  
      "maxPsd": 23  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6625,  
        "lowFrequency": 6605  
      },  
      "maxPsd": 23  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6645,  
        "lowFrequency": 6625  
      },  
      "maxPsd": 23  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6665,  
        "lowFrequency": 6645  
      },  
      "maxPsd": 23  
    },  
    {
```

```
"frequencyRange": {
  "highFrequency": 6685,
  "lowFrequency": 6665
},
"maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6705,
    "lowFrequency": 6685
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6725,
    "lowFrequency": 6705
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6745,
    "lowFrequency": 6725
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6765,
    "lowFrequency": 6745
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6785,
```

```
        "lowFrequency": 6765
      },
      "maxPsd": 23
    },
    {
      "frequencyRange": {
        "highFrequency": 6805,
        "lowFrequency": 6785
      },
      "maxPsd": 23
    },
    {
      "frequencyRange": {
        "highFrequency": 6825,
        "lowFrequency": 6805
      },
      "maxPsd": 23
    },
    {
      "frequencyRange": {
        "highFrequency": 6845,
        "lowFrequency": 6825
      },
      "maxPsd": 23
    },
    {
      "frequencyRange": {
        "highFrequency": 6865,
        "lowFrequency": 6845
      },
      "maxPsd": 23
    }
  ],
  "requestId": "114665199316912",
  "availabilityExpireTime": "2023-09-29T22:43:47Z",
  "rulesetId": "US_47_CFR_PART_15_SUBPART_E"
}
```

```
    ],
    "version": "1.4"
  }

##### 2023-09-28T22:43:47Z #####
{
  "headers": {
    "Host": "testserver.wfatestorg.org",
    "Accept": "*/*",
    "Content-Type": "application/json",
    "X-Forwarded-For": "209.206.53.23",
    "X-Forwarded-Host": "testserver.wfatestorg.org",
    "X-Forwarded-Server": "testserver.wfatestorg.org",
    "Content-Length": "726",
    "Connection": "Keep-Alive"
  },
  "body": {
    "version": "1.4",
    "availableSpectrumInquiryRequests": [
      {
        "requestId": "114665199316912",
        "deviceDescriptor": {
          "serialNumber": "Q5AG-EBKF-5MV4",
          "certificationId": [
            {
              "rulesetId": "US_47_CFR_PART_15_SUBPART_E",
              "nra": "FCC",
              "id": "LDK-9160S2579"
            }
          ]
        }
      }
    ],
    "location": {
      "ellipse": {
        "center": {
          "latitude": 38,
          "longitude": -122
        }
      }
    }
  }
}
```

```
        "majorAxis": 20,
        "minorAxis": 20,
        "orientation": 0
    },
    "elevation": {
        "height": 10.0,
        "heightType": "AGL",
        "verticalUncertainty": 10.0
    },
    "indoorDeployment": 1
},
"inquiredFrequencyRange": [
    {
        "lowFrequency": 5945,
        "highFrequency": 6875
    }
],
"vendorExtensions": [
    {
        "extensionId": "CiscoApInfo",
        "parameters": {
            "version": "1.4",
            "PID": "CW9166D1"
        }
    }
]
},
"vendorExtensions": [
    {
        "extensionId": "CiscoInfo",
        "parameters": {
            "version": "1.4",
            "source": "Cloud",
            "identity": 1003
        }
    }
]
```



```
    ]
  }
}

##### 2023-09-28T22:43:47Z #####
{
  "availableSpectrumInquiryResponses": [
    {
      "response": {
        "responseCode": 0,
        "shortDescription": "SUCCESS"
      },
      "availableFrequencyInfo": [
        {
          "frequencyRange": {
            "highFrequency": 5965,
            "lowFrequency": 5945
          },
          "maxPsd": 23
        },
        {
          "frequencyRange": {
            "highFrequency": 5985,
            "lowFrequency": 5965
          },
          "maxPsd": 23
        },
        {
          "frequencyRange": {
            "highFrequency": 6005,
            "lowFrequency": 5985
          },
          "maxPsd": 23
        },
        {
          "frequencyRange": {
            "highFrequency": 6025,
```

```

        "lowFrequency": 6005
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6045,
        "lowFrequency": 6025
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6065,
        "lowFrequency": 6045
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6085,
        "lowFrequency": 6065
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6105,
        "lowFrequency": 6085
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6125,
        "lowFrequency": 6105
    },

```

```
"maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6145,
    "lowFrequency": 6125
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6165,
    "lowFrequency": 6145
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6185,
    "lowFrequency": 6165
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6205,
    "lowFrequency": 6185
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6245,
    "lowFrequency": 6225
  },
  "maxPsd": 23
},
},
```

```
{
  "frequencyRange": {
    "highFrequency": 6265,
    "lowFrequency": 6245
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6285,
    "lowFrequency": 6265
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6305,
    "lowFrequency": 6285
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6325,
    "lowFrequency": 6305
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
    "highFrequency": 6345,
    "lowFrequency": 6325
  },
  "maxPsd": 23
},
{
  "frequencyRange": {
```

```
        "highFrequency": 6365,
        "lowFrequency": 6345
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6385,
        "lowFrequency": 6365
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6405,
        "lowFrequency": 6385
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6425,
        "lowFrequency": 6405
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6545,
        "lowFrequency": 6525
    },
    "maxPsd": 23
},
{
    "frequencyRange": {
        "highFrequency": 6565,
        "lowFrequency": 6545
```

```
    },  
    "maxPsd": 23  
  },  
  {  
    "frequencyRange": {  
      "highFrequency": 6585,  
      "lowFrequency": 6565  
    },  
    "maxPsd": 23  
  },  
  {  
    "frequencyRange": {  
      "highFrequency": 6605,  
      "lowFrequency": 6585  
    },  
    "maxPsd": 23  
  },  
  {  
    "frequencyRange": {  
      "highFrequency": 6625,  
      "lowFrequency": 6605  
    },  
    "maxPsd": 23  
  },  
  {  
    "frequencyRange": {  
      "highFrequency": 6645,  
      "lowFrequency": 6625  
    },  
    "maxPsd": 23  
  },  
  {  
    "frequencyRange": {  
      "highFrequency": 6665,  
      "lowFrequency": 6645  
    },  
    "maxPsd": 23  
  }
```

```
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6685,  
        "lowFrequency": 6665  
      },  
      "maxPsd": 23  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6705,  
        "lowFrequency": 6685  
      },  
      "maxPsd": 23  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6725,  
        "lowFrequency": 6705  
      },  
      "maxPsd": 23  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6745,  
        "lowFrequency": 6725  
      },  
      "maxPsd": 23  
    },  
    {  
      "frequencyRange": {  
        "highFrequency": 6765,  
        "lowFrequency": 6745  
      },  
      "maxPsd": 23  
    },  
    {
```

```
        "frequencyRange": {
            "highFrequency": 6785,
            "lowFrequency": 6765
        },
        "maxPsd": 23
    },
    {
        "frequencyRange": {
            "highFrequency": 6805,
            "lowFrequency": 6785
        },
        "maxPsd": 23
    },
    {
        "frequencyRange": {
            "highFrequency": 6825,
            "lowFrequency": 6805
        },
        "maxPsd": 23
    },
    {
        "frequencyRange": {
            "highFrequency": 6845,
            "lowFrequency": 6825
        },
        "maxPsd": 23
    },
    {
        "frequencyRange": {
            "highFrequency": 6865,
            "lowFrequency": 6845
        },
        "maxPsd": 23
    }
],
"requestId": "114665199316912",
"availabilityExpireTime": "2023-09-29T22:43:47Z",
```




```
"rulesetId": "US_47_CFR_PART_15_SUBPART_E"
    }
  ],
  "version": "1.4"
}
```

AFC capability - Inquired Channel
AFCD.RSA: Successful registration and spectrum access request

Freq. (MHz)	Mode (LPI or SP)	Bandwidth (MHz)	Antenna Gain (dBi)	Power (dBm)	EIRP (dBm)	AFC Response Limit (dBm)	Result	PSD (dBm/MHz)	EIRP PSD (dBm/MHz)	AFC Response Limit (dBm/MHz)	Result
5975	LPI	20	6.49	9.65	16.14	-	N/A	-3.84	2.65	5	Pass
6135	SP	20	6.49	10.61	17.10	22.2	Pass	-2.98	3.51	-	N/A
6695	SP	20	7.65	11.32	18.97	26.92	Pass	-1.90	5.75	-	N/A
6685	LPI	40	7.65	11.86	19.51	-	N/A	-4.66	2.99	5	Pass
6045	SP	40	6.49	12.29	18.78	30.72	Pass	-4.02	2.47	-	N/A
6125	SP	40	6.49	13.49	19.98	24.2	Pass	-3.71	2.78	-	N/A
6225	LPI	80	6.49	10.31	16.80	-	N/A	-9.45	-2.96	5	Pass
6225	SP	80	6.49	10.67	17.16	31.26	Pass	-7.21	-0.72	-	N/A
6385	SP	80	6.49	11.07	17.56	33.15	Pass	-6.96	-0.47	-	N/A
6185	LPI	160	6.49	9.89	16.38	-	N/A	-11.39	-4.90	5	Pass
6665	SP	160	7.65	10.45	18.10	30.27	Pass	-9.63	-1.98	-	N/A
6185	SP	160	6.49	10.58	17.07	31.05	Pass	-9.29	-2.80	-	N/A

AFCD.USA: Unsuccessful spectrum access request

Freq. (MHz)	Mode (LPI or SP)	Bandwidth (MHz)	Antenna Gain (dBi)	Power (dBm)	EIRP (dBm)	AFC Response Limit (dBm)	Result	PSD (dBm/MHz)	EIRP PSD (dBm/MHz)	AFC Response Limit (dBm/MHz)	Result
6135	LPI	20	6.49	9.08	15.57	-	N/A	-4.22	2.27	5	Pass
6135	LPI	20	6.49	9.33	15.82	-	N/A	-4.20	2.29	5	Pass

AFCD.SAU: Successful spectrum access update

Freq. (MHz)	Mode (LPI or SP)	Bandwidth (MHz)	Antenna Gain (dBi)	Power (dBm)	EIRP (dBm)	AFC Response Limit (dBm)	Result	PSD (dBm/MHz)	EIRP PSD (dBm/MHz)	AFC Response Limit (dBm/MHz)	Result
6135	LPI	20	6.49	9.34	15.83	-	N/A	-4.18	2.31	5	Pass
6215	SP	20	6.49	10.77	17.26	26.17	Pass	-2.36	4.13	-	N/A
6215	LPI	20	6.49	8.91	15.40	-	N/A	-4.79	1.70	5	Pass

AFCD.UAU: Unsuccessful spectrum access update

Freq. (MHz)	Mode (LPI or SP)	Bandwidth (MHz)	Antenna Gain (dBi)	Power (dBm)	EIRP (dBm)	AFC Response Limit (dBm)	Result	PSD (dBm/MHz)	EIRP PSD (dBm/MHz)	AFC Response Limit (dBm/MHz)	Result
6215	LPI	20	6.49	8.96	15.45	-	N/A	-4.73	1.76	5	Pass
6215	SP	20	6.49	10.77	17.26	36	Pass	-2.50	3.99	-	N/A
6215	LPI	20	6.49	9.19	15.68	-	N/A	-4.59	1.90	5	Pass

AFC capability - Inquired Channel

CT_AFC_SP_AP_AFCRSA31_Channel_20MHz_10618_1


Frequency (MHz): 5975

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

5975MHz_TX

21/09/2023

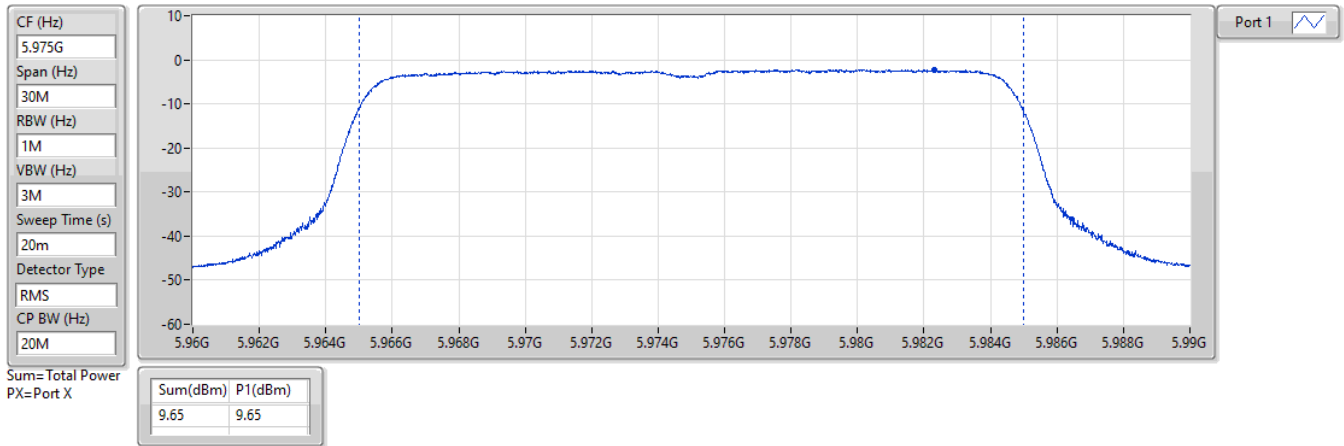


5.925-6.425GHz_802.11ax HEW20_1TX

PSD

5975MHz

21/09/2023

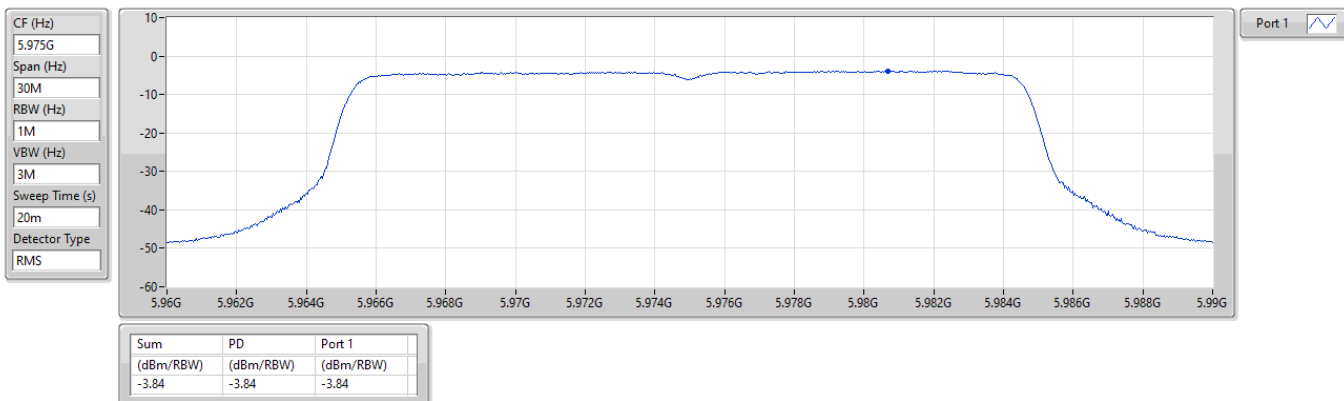


Frequency (MHz): 6135

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6135MHz_TX

21/09/2023

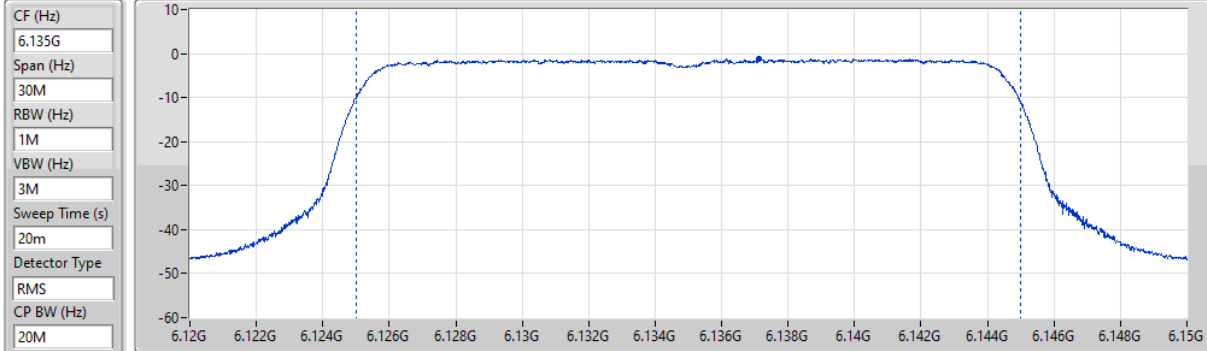


5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6135MHz

21/09/2023

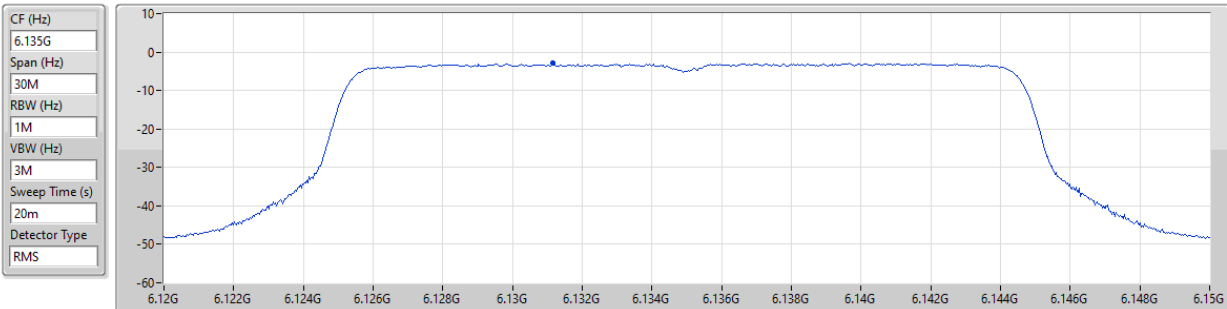

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-2.98	-2.98	-2.98

Frequency (MHz): 6695

6.525-6.875GHz_802.11ax HEW20_1TX


AV Power

6695MHz_TX

21/09/2023

CF (Hz)
6.695G
Span (Hz)
30M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS
CP BW (Hz)
20M

Sum=Total Power
PX=Port X

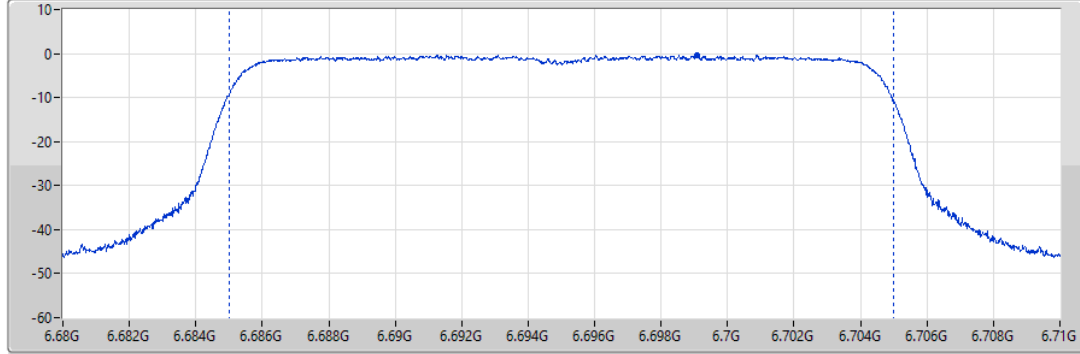

Port 1

Sum(dBm)	P1(dBm)
11.32	11.32


6.525-6.875GHz_802.11ax HEW20_1TX

PSD

6695MHz

21/09/2023

CF (Hz)
6.695G
Span (Hz)
30M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

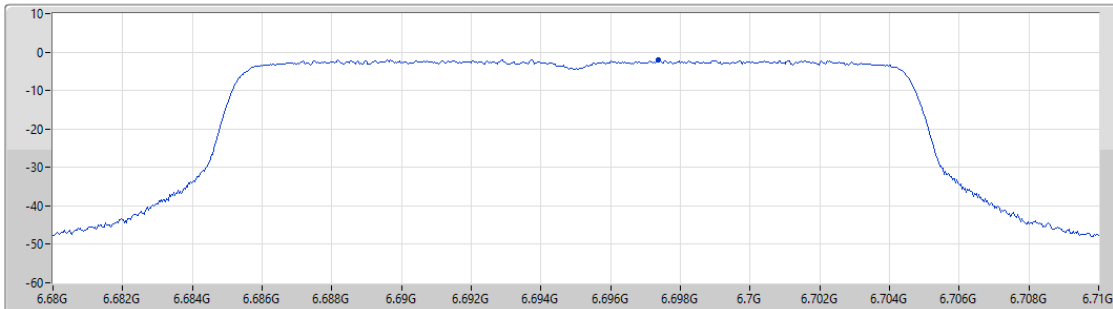

Port 1

Sum (dBm/Hz)	PD (dBm/Hz)	Port 1 (dBm/Hz)
-1.90	-1.90	-1.90

CT_AFC_SP_AP_AFCRSA31_Channel_40MHz_10619_1

Frequency (MHz): 6685

6.525-6.875GHz_802.11ax HEW40_1TX


AV Power

6685MHz_TX

21/09/2023

CF (Hz)
6.685G
Span (Hz)
60M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS
CP BW (Hz)
40M

Sum=Total Power
PX=Port X

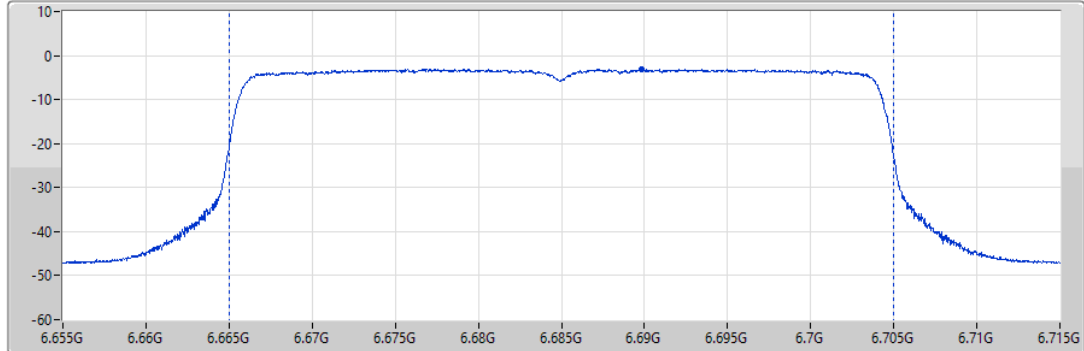

Port 1

Sum(dBm)	P1(dBm)
11.86	11.86


6.525-6.875GHz_802.11ax HEW40_1TX

PSD

6685MHz

21/09/2023

CF (Hz)
6.685G
Span (Hz)
60M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

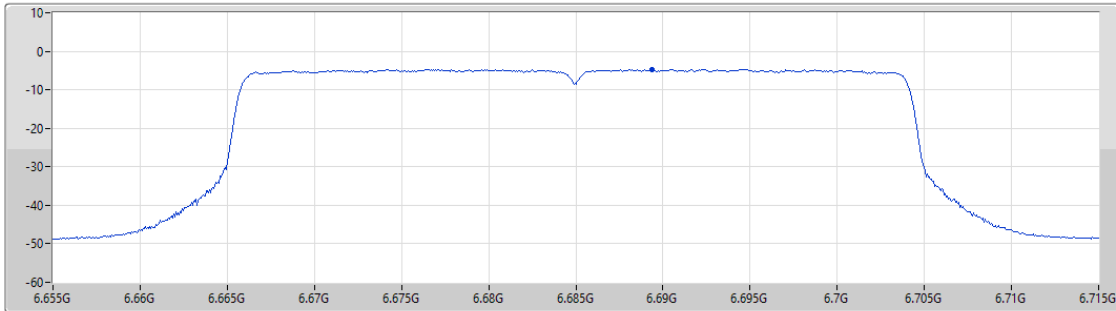

Port 1

Sum	PD	Port 1
(dBm/Hz)	(dBm/Hz)	(dBm/Hz)
-4.66	-4.66	-4.66

Frequency (MHz): 6045

5.925-6.425GHz_802.11ax HEW40_1TX

AV Power

6045MHz_TX

21/09/2023

CF (Hz)
6.045G

Span (Hz)
60M


RBW (Hz)
1M

VBW (Hz)
3M

Sweep Time (s)
20m

Detector Type
RMS

CP BW (Hz)
40M

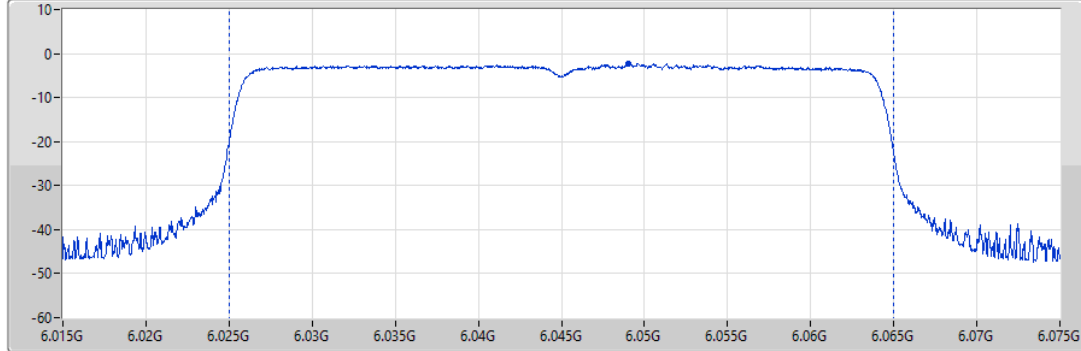

Port 1

Sum=Total Power
PX=Port X

Sum(dBm)	P1(dBm)
12.29	12.29

5.925-6.425GHz_802.11ax HEW40_1TX

PSD

6045MHz

21/09/2023

CF (Hz)
6.045G


Span (Hz)
60M

RBW (Hz)
1M

VBW (Hz)
3M

Sweep Time (s)
20m

Detector Type
RMS

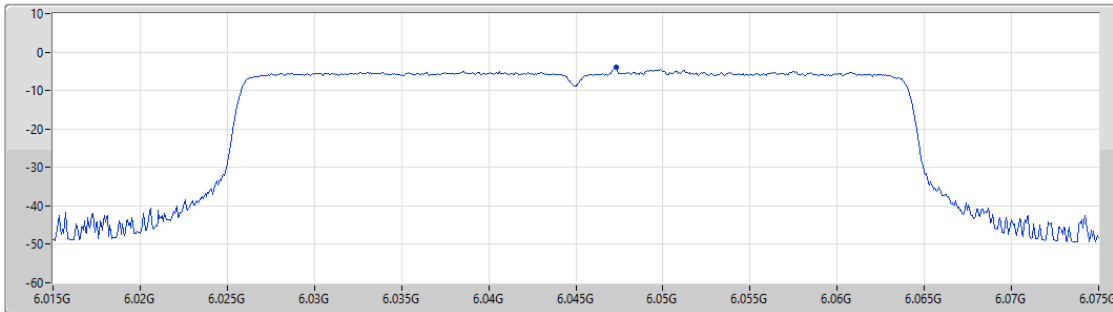

Port 1

Sum (dBm/RBW)	PD (dBm/RBW)	Port 1 (dBm/RBW)
-4.02	-4.02	-4.02


Frequency (MHz): 6125

5.925-6.425GHz_802.11ax HEW40_1TX

AV Power

6125MHz_TX

21/09/2023

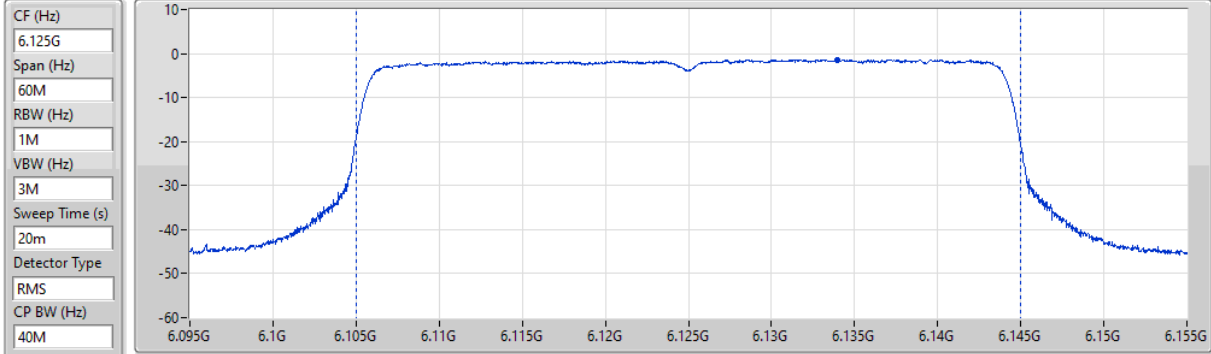


5.925-6.425GHz_802.11ax HEW40_1TX

PSD

6125MHz

21/09/2023

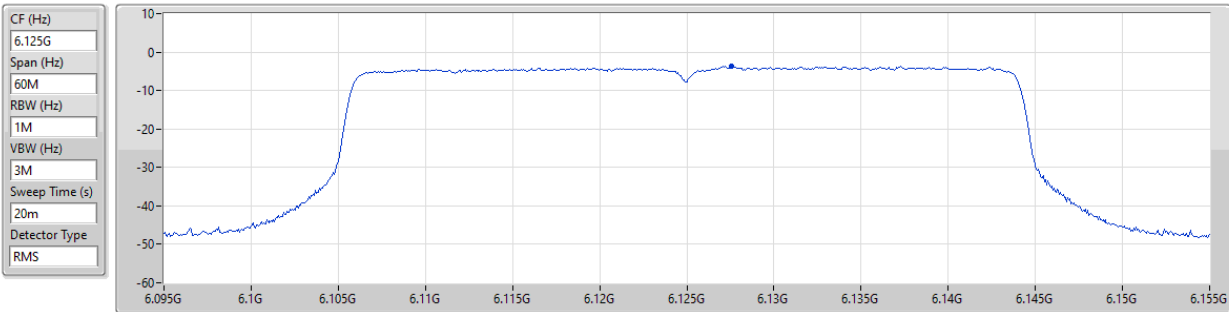

CT_AFC_SP_AP_AFCRSA31_Channel_80MHz_10620_1


Frequency (MHz): 6225

5.925-6.425GHz_802.11ax HEW80_1TX

AV Power

6225MHz_TX

21/09/2023

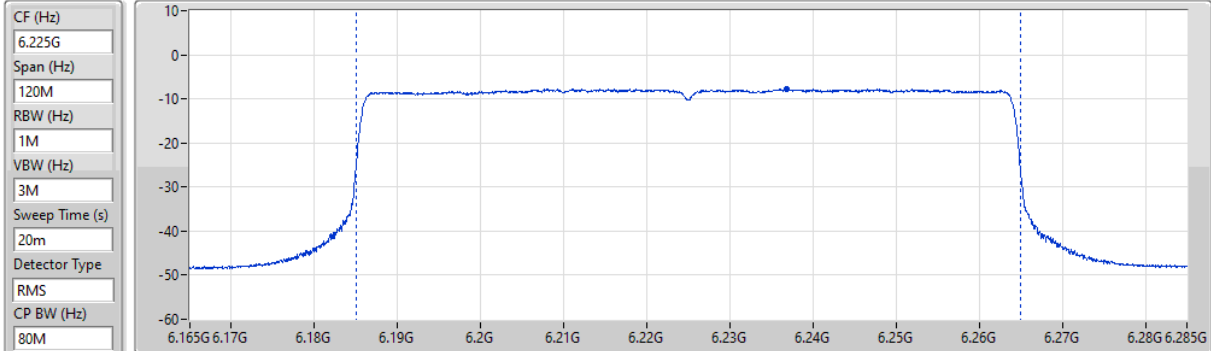

Sum=Total Power
 PX=Port X


Sum(dBm)	P1(dBm)
10.31	10.31

5.925-6.425GHz_802.11ax HEW80_1TX

PSD

6225MHz

21/09/2023

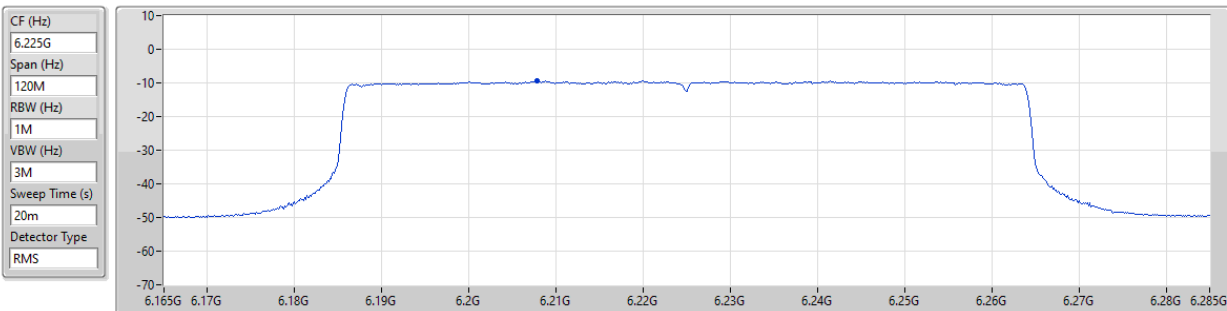

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-9.45	-9.45	-9.45


Frequency (MHz): 6225

5.925-6.425GHz_802.11ax HEW80_1TX

AV Power

6225MHz_TX

21/09/2023

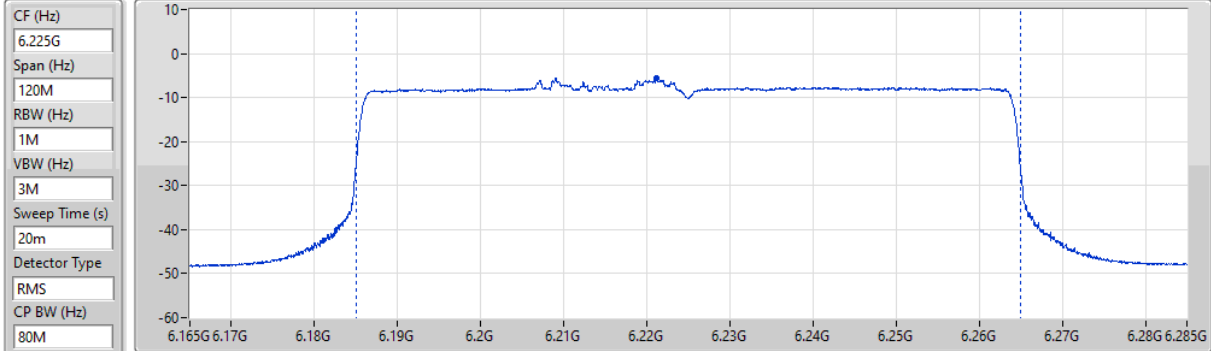
Sum=Total Power
PX=Port X


Sum(dBm)	P1(dBm)
10.67	10.67

5.925-6.425GHz_802.11ax HEW80_1TX

PSD

6225MHz

21/09/2023

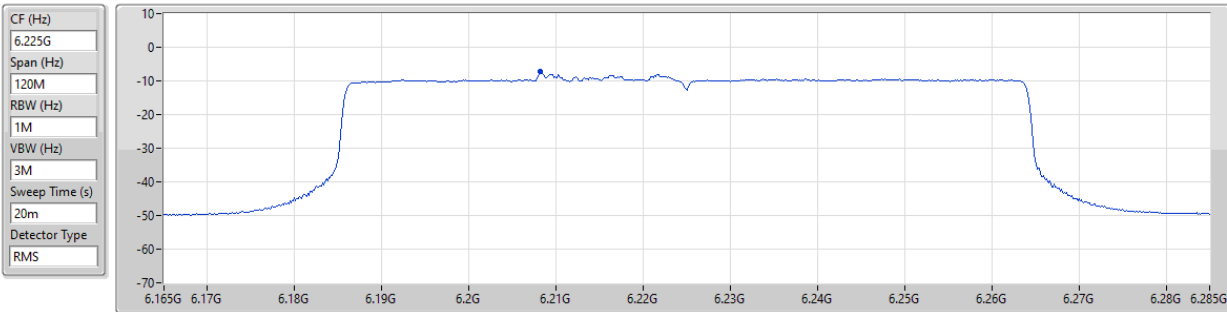

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-7.21	-7.21	-7.21

Frequency (MHz): 6385

5.925-6.425GHz_802.11ax HEW80_1TX


AV Power

6385MHz_TX

21/09/2023

CF (Hz)
6.385G
Span (Hz)
120M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS
CP BW (Hz)
80M

Sum=Total Power
PX=Port X

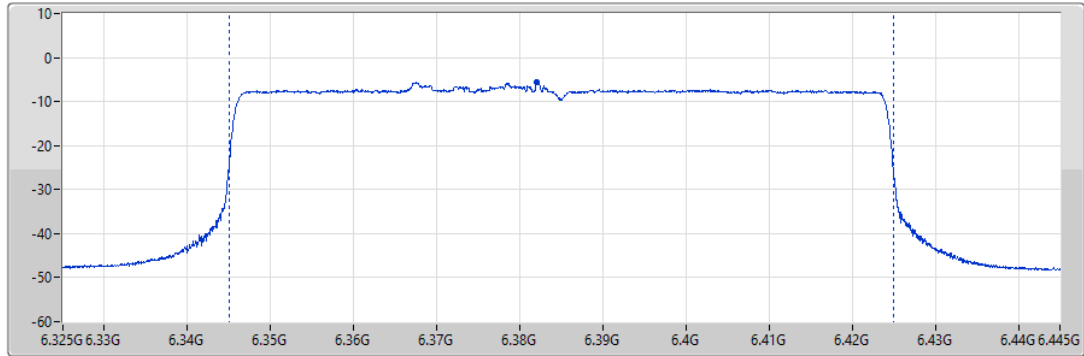

Port 1

Sum(dBm)	P1(dBm)
11.07	11.07


5.925-6.425GHz_802.11ax HEW80_1TX

PSD

6385MHz

21/09/2023

CF (Hz)
6.385G
Span (Hz)
120M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

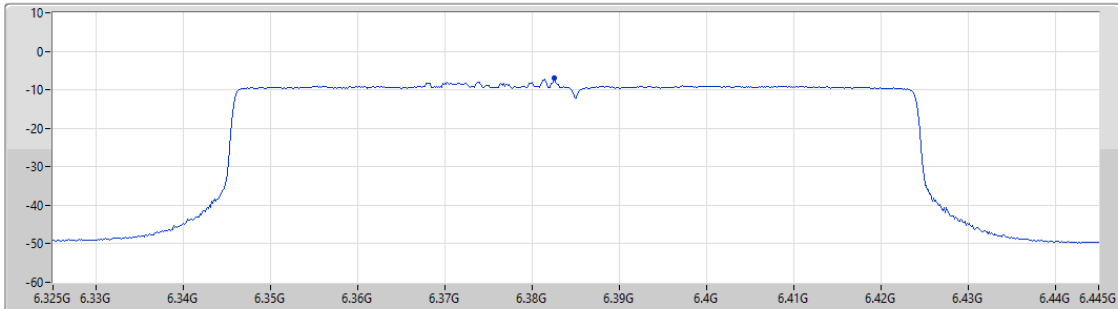

Port 1

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-6.96	-6.96	-6.96

CT_AFC_SP_AP_AFCDRSA31_Channel_160MHz_10621_1

Frequency (MHz): 6185

5.925-6.425GHz_802.11ax HEW160_1TX


AV Power

6185MHz_TX

21/09/2023

CF (Hz)
6.185G
Span (Hz)
240M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS
CP BW (Hz)
160M

Sum=Total Power
PX=Port X

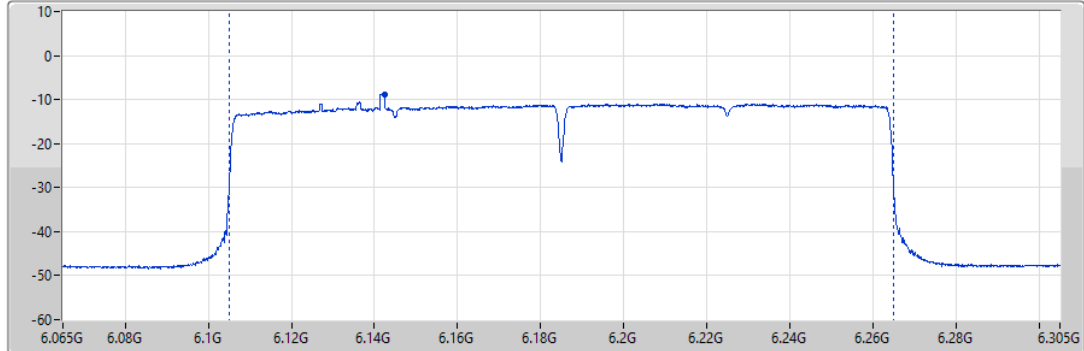

Port 1

Sum(dBm)	P1(dBm)
9.89	9.89


5.925-6.425GHz_802.11ax HEW160_1TX

PSD

6185MHz

21/09/2023

CF (Hz)
6.185G
Span (Hz)
240M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

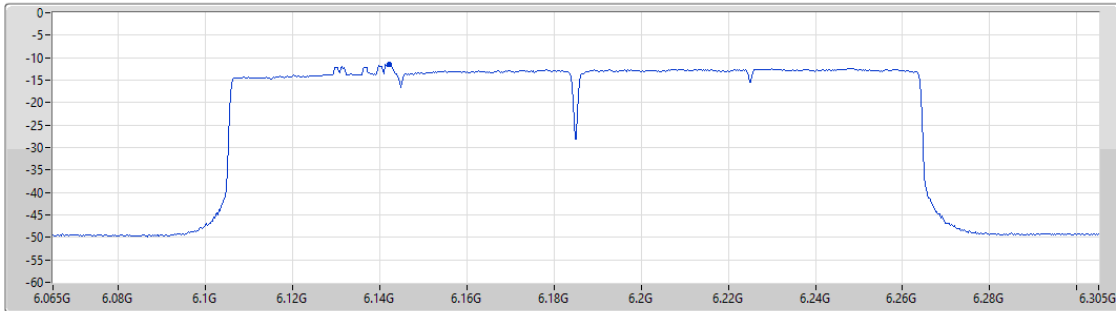

Port 1

Sum (dBm/RBW)	PD (dBm/RBW)	Port 1 (dBm/RBW)
-11.39	-11.39	-11.39


Frequency (MHz): 6665

6.525-6.875GHz_802.11ax HEW160_1TX

AV Power

6665MHz_TX

21/09/2023

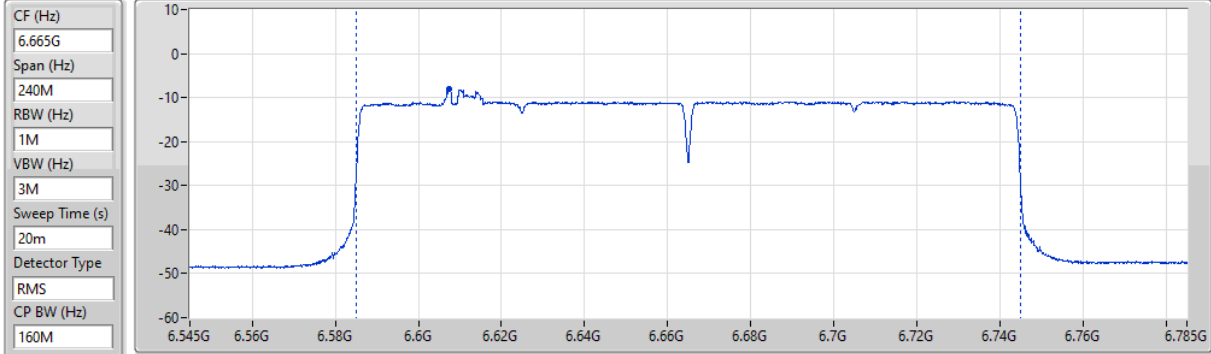

Sum=Total Power
PX=Port X


Sum(dBm)	P1(dBm)
10.45	10.45

6.525-6.875GHz_802.11ax HEW160_1TX

PSD

6665MHz

21/09/2023

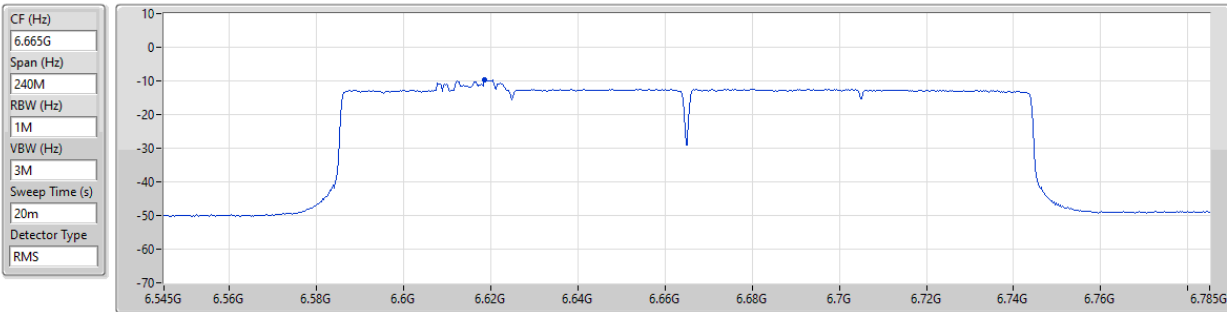

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-9.63	-9.63	-9.63


Frequency (MHz): 6185

5.925-6.425GHz_802.11ax HEW160_1TX

AV Power

6185MHz_TX

21/09/2023

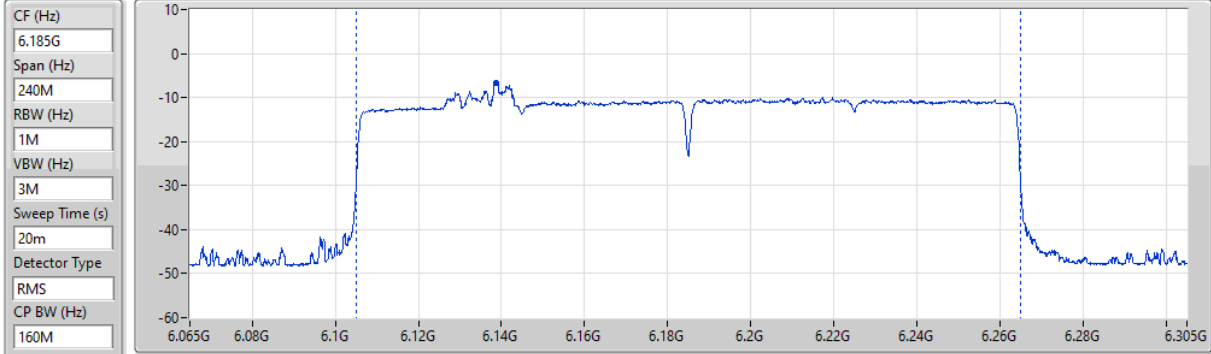

Sum=Total Power
PX=Port X


Sum(dBm)	P1(dBm)
10.58	10.58

5.925-6.425GHz_802.11ax HEW160_1TX

PSD

6185MHz

21/09/2023

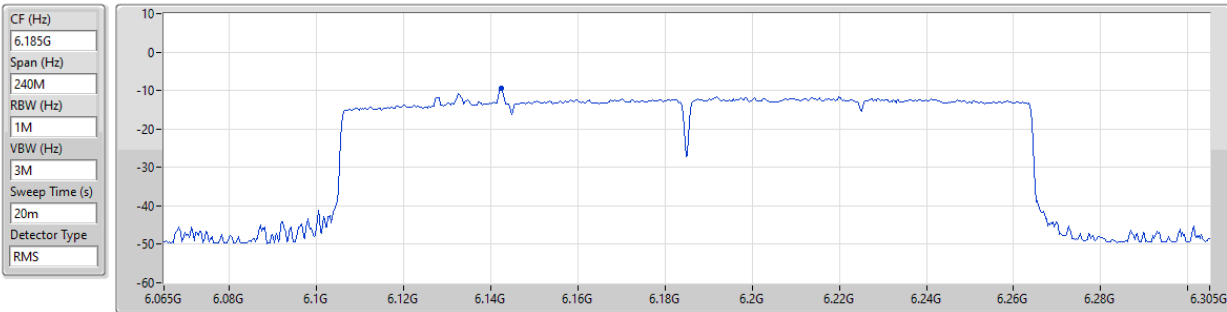

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-9.29	-9.29	-9.29

CT_AFC_SP_AP_AFCDUSA32_Channel_10622_1

Bandwidth: 20MHz


Frequency (MHz): 6135

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6135MHz_TX

21/09/2023

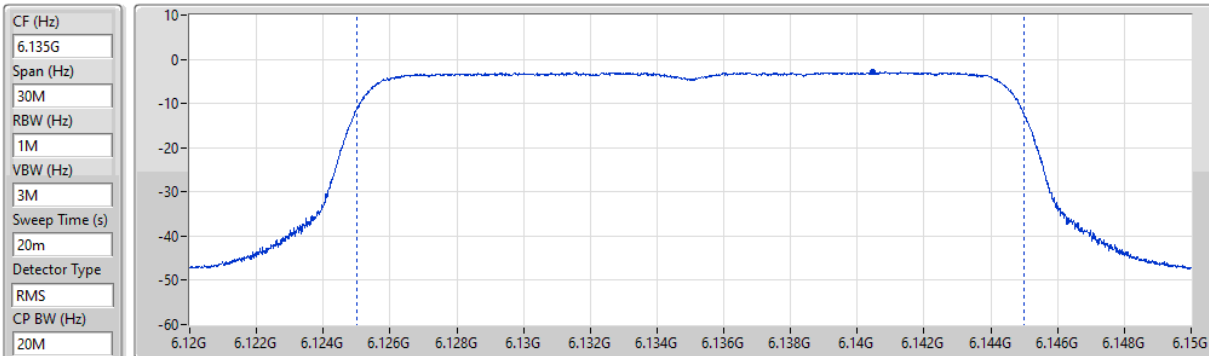

Sum=Total Power
 PX=Port X


Sum(dBm)	P1(dBm)
9.08	9.08

5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6135MHz

21/09/2023

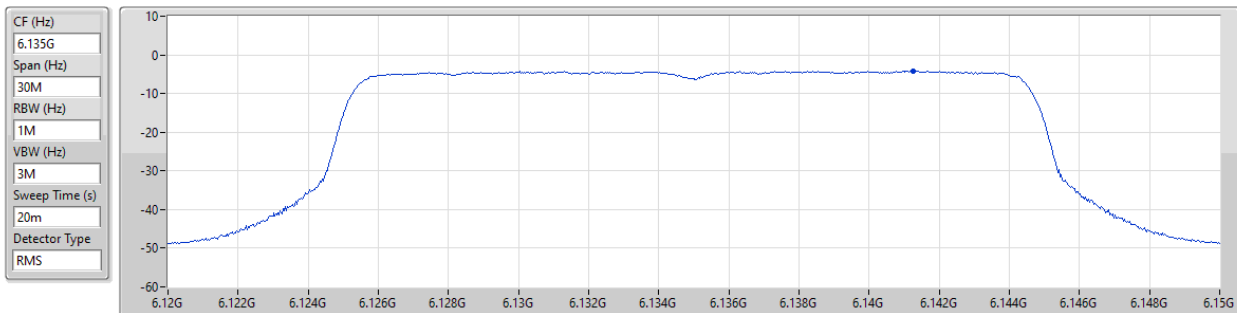

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-4.22	-4.22	-4.22

Frequency (MHz): 6135

5.925-6.425GHz_802.11ax HEW20_1TX


AV Power

6135MHz_TX

21/09/2023

CF (Hz)
6.135G
Span (Hz)
30M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS
CP BW (Hz)
20M

Sum=Total Power
PX=Port X

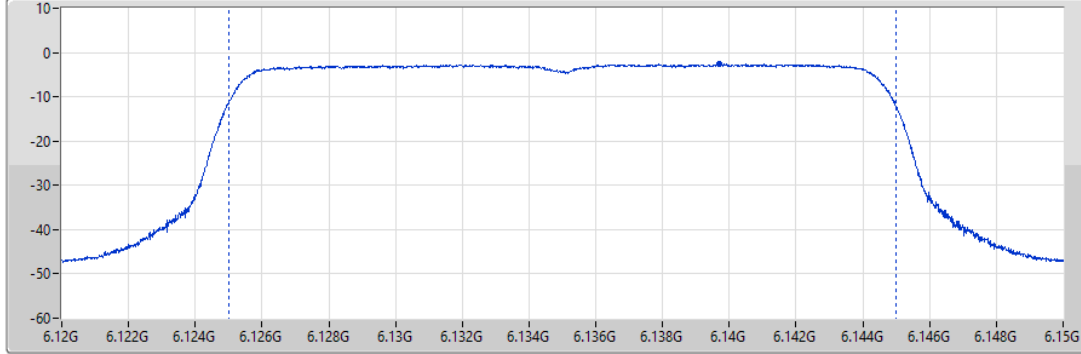

Port 1

Sum(dBm)	P1(dBm)
9.33	9.33


5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6135MHz

21/09/2023

CF (Hz)
6.135G
Span (Hz)
30M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

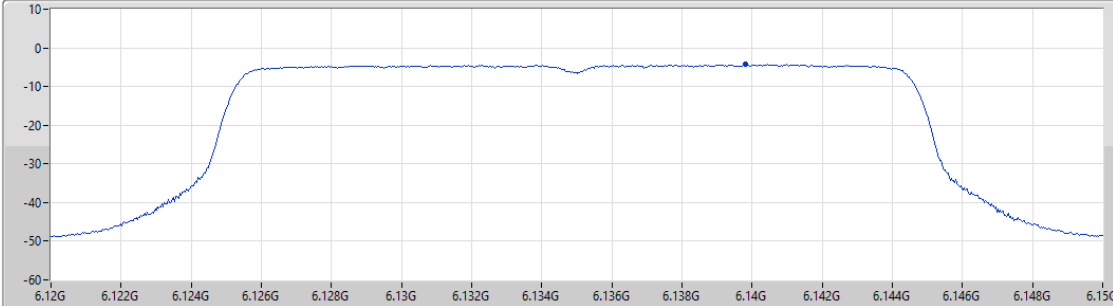

Port 1

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-4.20	-4.20	-4.20

CT_AFC_SP_AP_AFCDSAU33_Channel_10623_1

Bandwidth: 20MHz


Frequency (MHz): 6135

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6135MHz_TX

21/09/2023

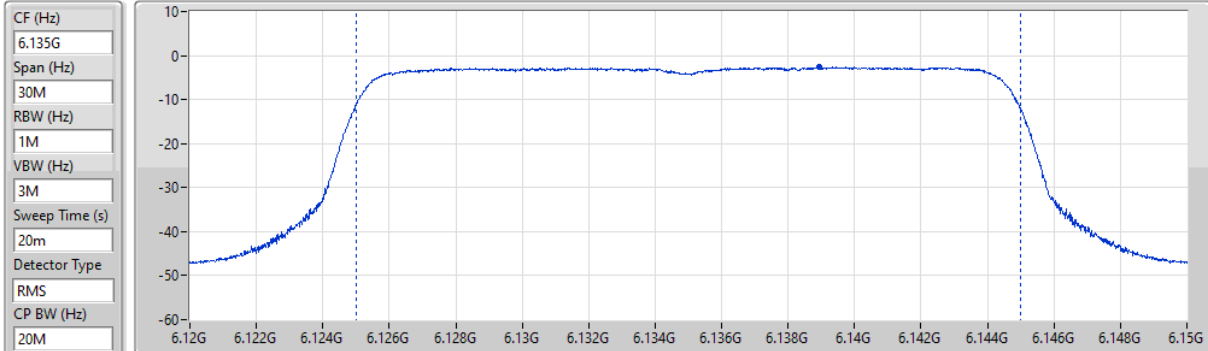


5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6135MHz

21/09/2023

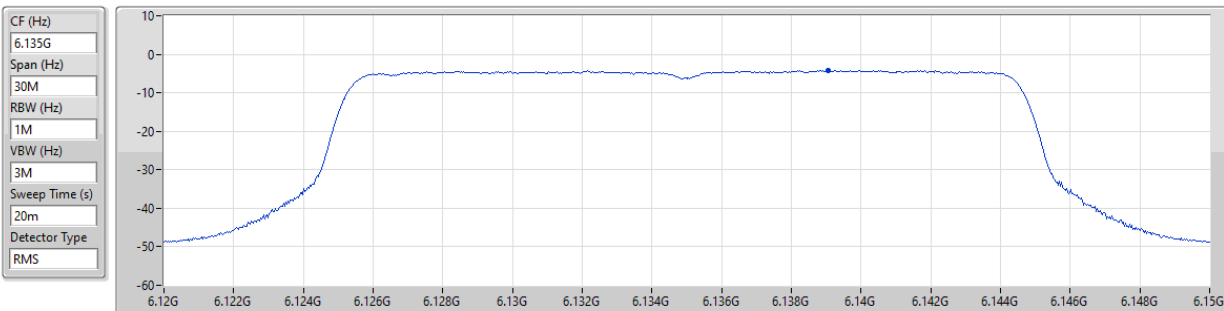


Frequency (MHz): 6215

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6215MHz_TX

21/09/2023

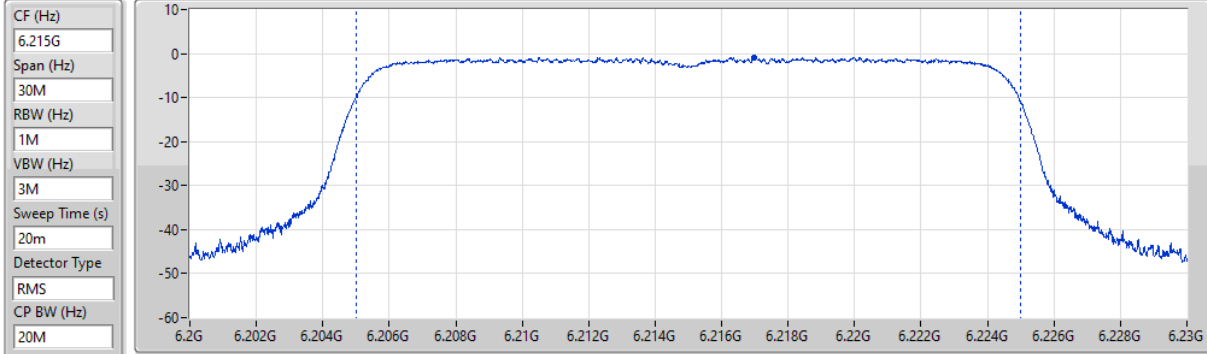

Sum=Total Power
 PX=Port X


Sum(dBm)	P1(dBm)
10.77	10.77

5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6215MHz

21/09/2023

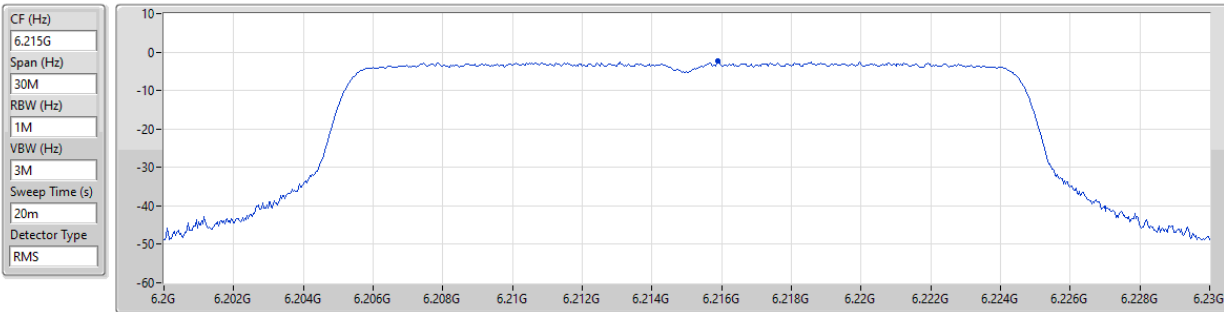

Sum	PD	Port 1
(dBm/Hz)	(dBm/Hz)	(dBm/Hz)
-2.36	-2.36	-2.36

Frequency (MHz): 6215

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6215MHz_TX

21/09/2023

CF (Hz)
6.215G

Span (Hz)
30M

RBW (Hz)
1M


VBW (Hz)
3M

Sweep Time (s)
20m

Detector Type
RMS

CP BW (Hz)
20M

Sum=Total Power
PX=Port X

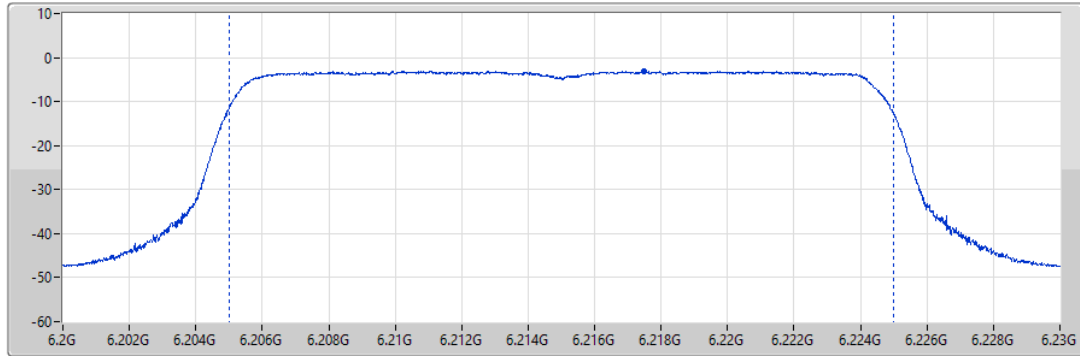

Port 1

Sum(dBm)	P1(dBm)
8.91	8.91

5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6215MHz

21/09/2023

CF (Hz)
6.215G


Span (Hz)
30M

RBW (Hz)
1M

VBW (Hz)
3M

Sweep Time (s)
20m

Detector Type
RMS

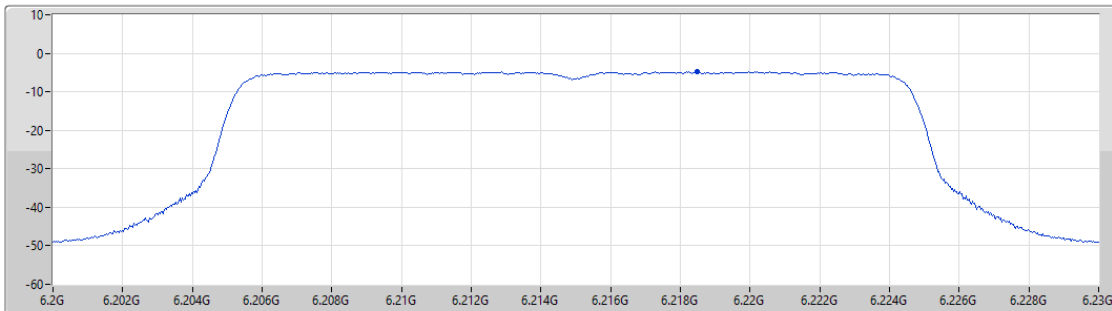

Port 1

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-4.79	-4.79	-4.79

CT_AFC_SP_AP_AFCDUAU34_Channel_10624_1

Bandwidth: 20MHz


Frequency (MHz): 6215

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6215MHz_TX

21/09/2023

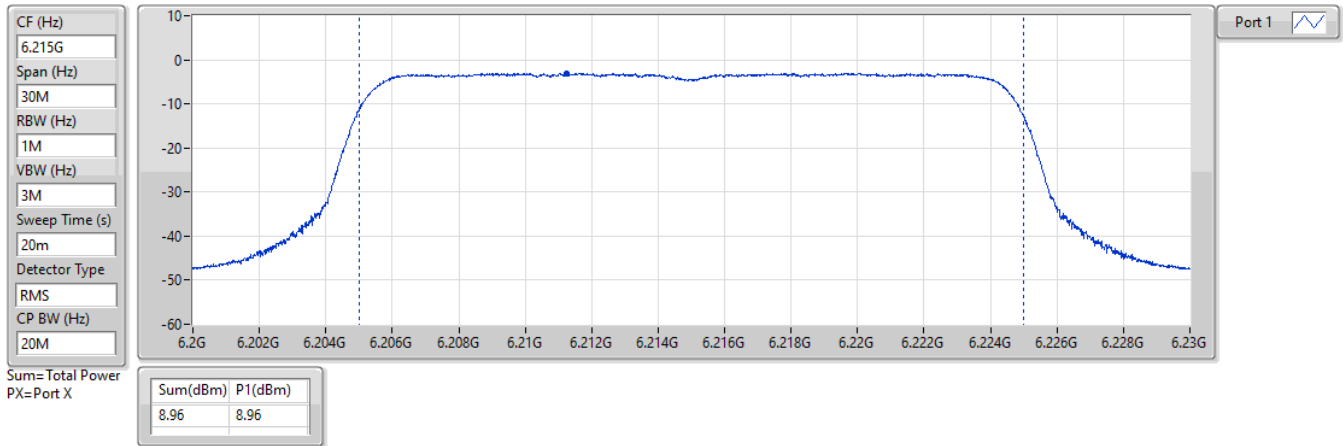


5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6215MHz

21/09/2023

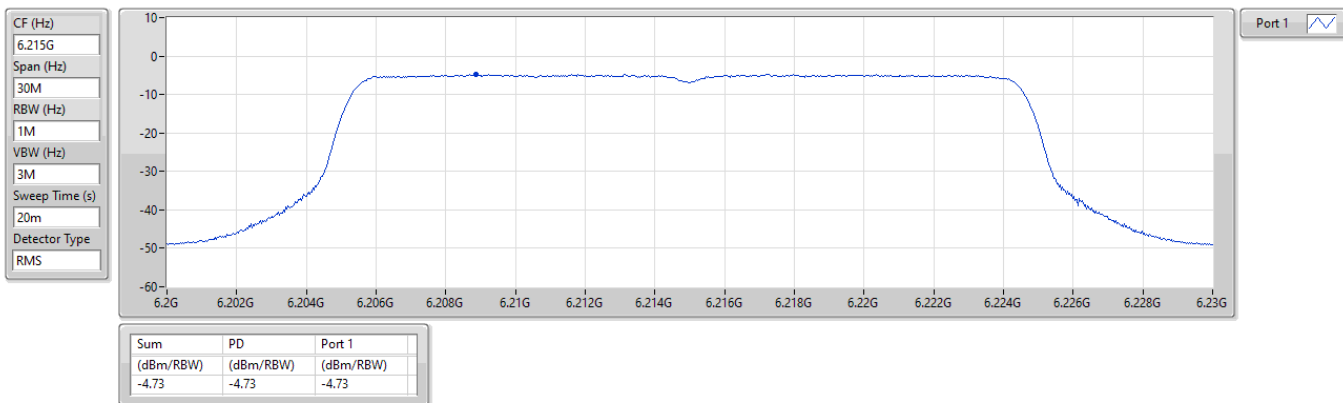


Frequency (MHz): 6215

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6215MHz_TX

21/09/2023

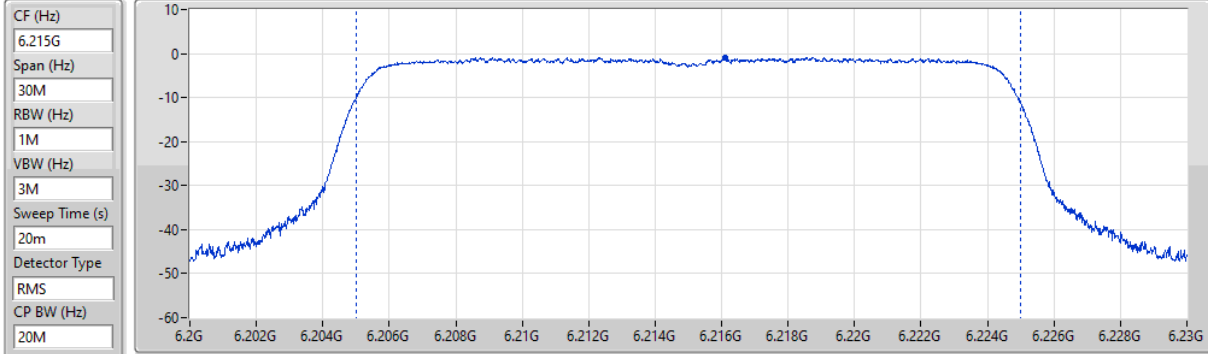


5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6215MHz

21/09/2023

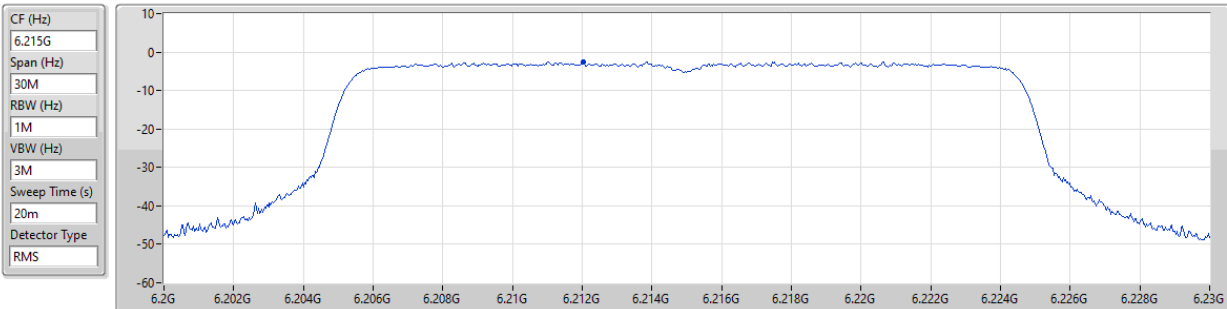

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-2.50	-2.50	-2.50

Frequency (MHz): 6215

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6215MHz_TX

21/09/2023

CF (Hz)
6.215G

Span (Hz)
30M

RBW (Hz)
1M


VBW (Hz)
3M

Sweep Time (s)
20m

Detector Type
RMS

CP BW (Hz)
20M

Sum=Total Power
PX=Port X

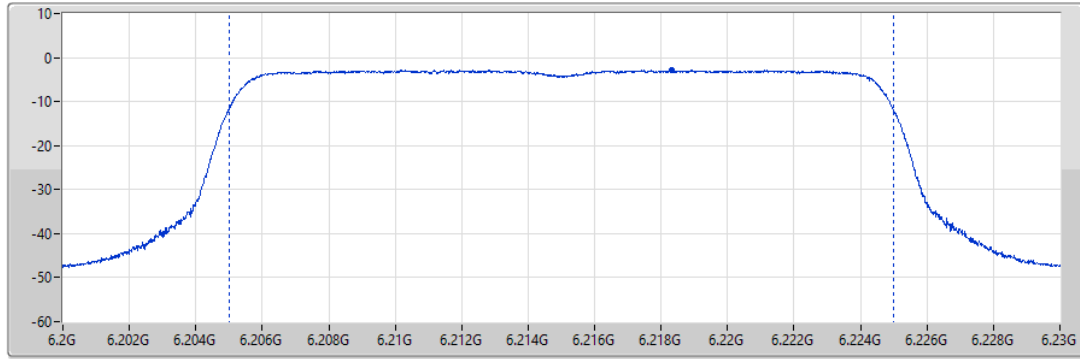

Port 1

Sum(dBm)	P1(dBm)
9.19	9.19

5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6215MHz

21/09/2023

CF (Hz)
6.215G


Span (Hz)
30M

RBW (Hz)
1M

VBW (Hz)
3M

Sweep Time (s)
20m

Detector Type
RMS

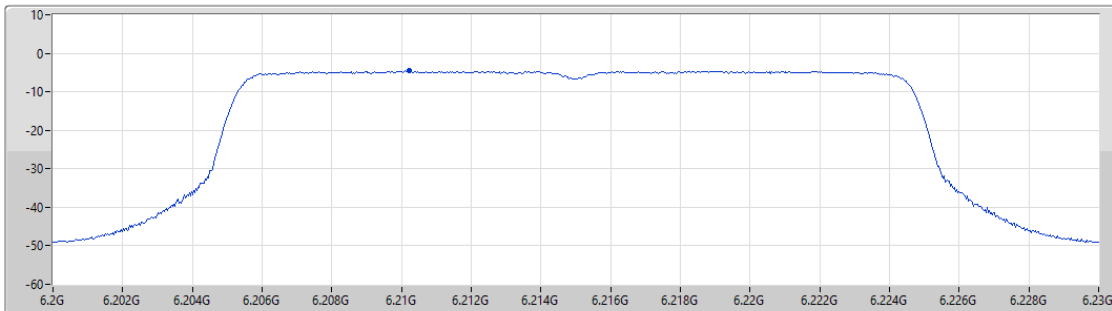


Port 1

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-4.59	-4.59	-4.59

Duty Cycle


Bandwidth: 20MHz

DC;ax20;BWch:20

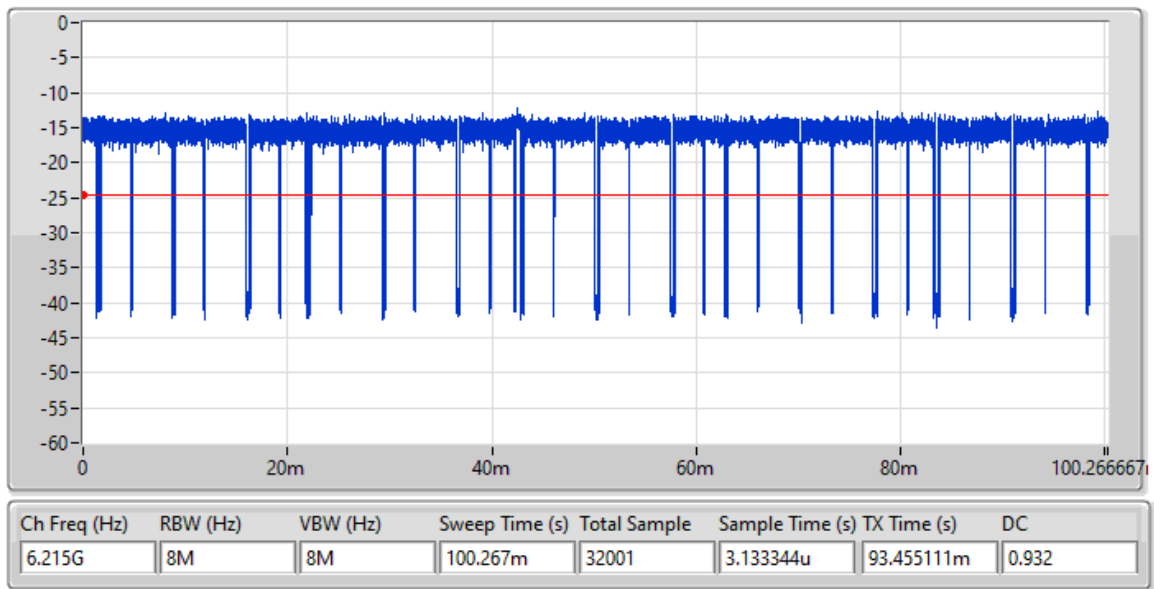


Bandwidth: 40MHz

DC;ax40;BWch:40

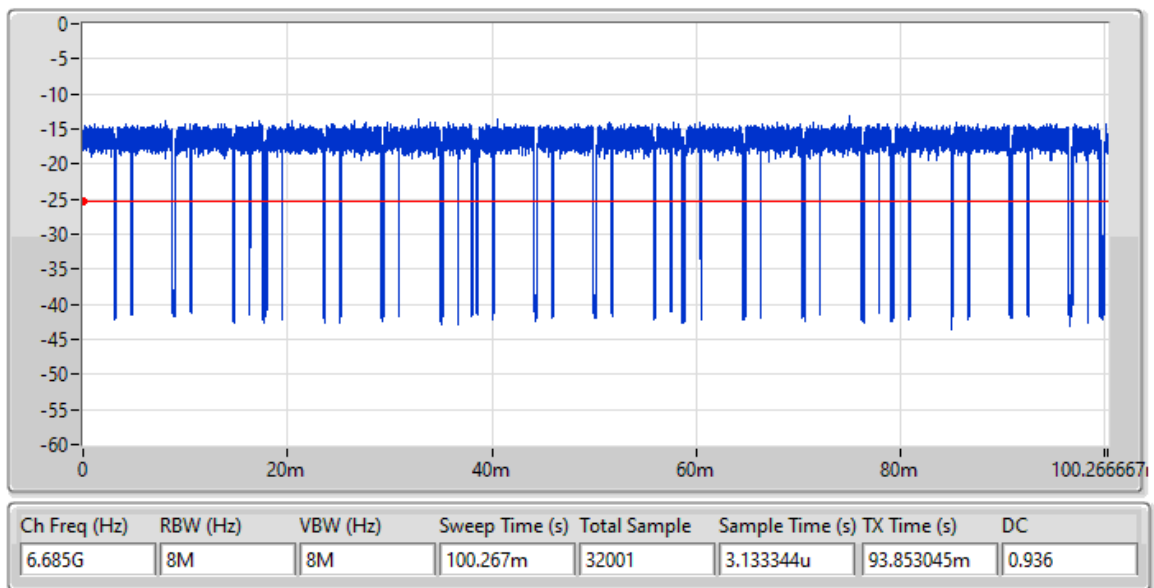


Bandwidth: 80MHz

DC;ax80;BWch:80

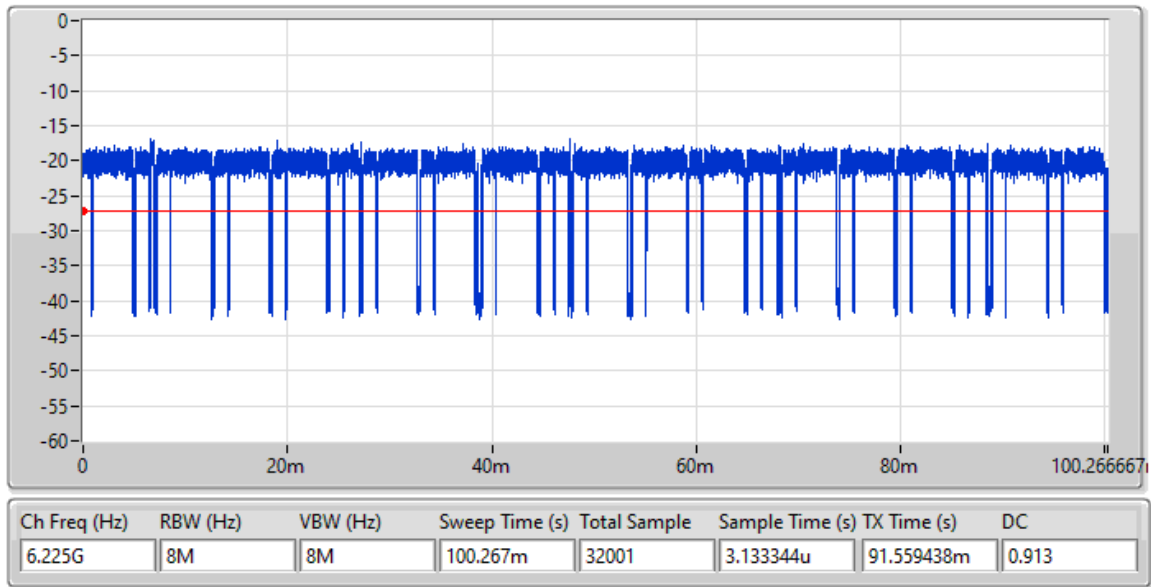

Bandwidth: 160MHz

DC;ax160;BWch:160

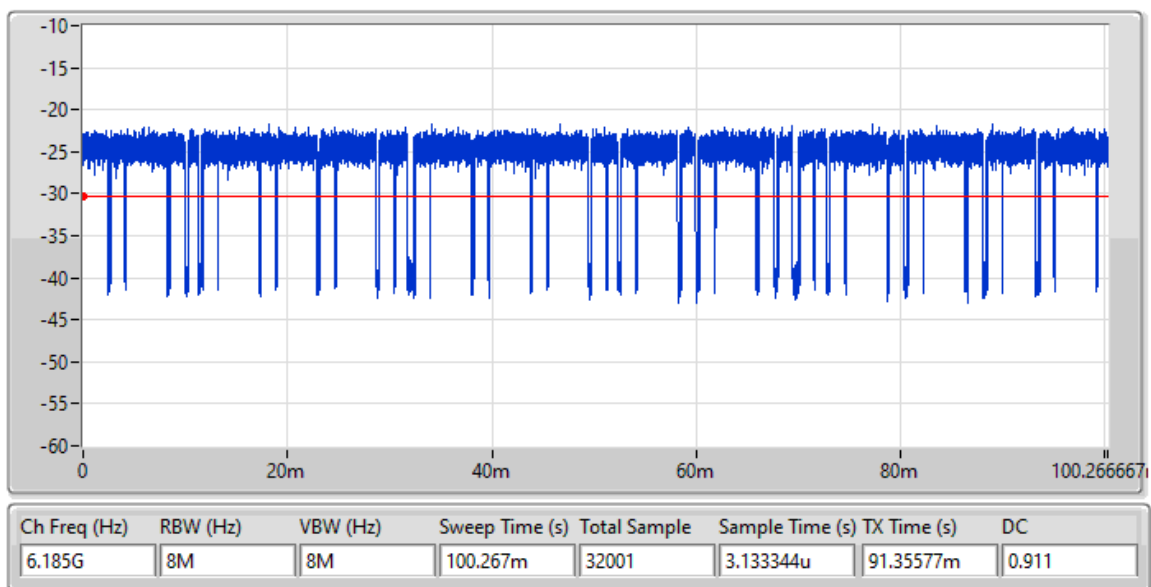

AFC capability - Inquired Frequency
AFCD.RSA: Successful registration and spectrum access request

Freq. (MHz)	Mode (LPI or SP)	Bandwidth (MHz)	Antenna Gain (dBi)	Power (dBm)	EIRP (dBm)	AFC Response Limit (dBm)	Result	PSD (dBm/MHz)	EIRP PSD (dBm/MHz)	AFC Response Limit (dBm/MHz)	Result
6055	LPI	20	6.49	10.48	16.97	-	N/A	-2.71	3.78	5	Pass
6695	SP	20	7.65	12.01	19.66	-	N/A	-1.11	6.54	15.17	Pass
5975	SP	20	6.49	13.37	19.86	-	N/A	0.32	6.81	18.25	Pass
5965	LPI	40	6.49	13.91	20.40	-	N/A	-2.16	4.33	5	Pass
6125	SP	40	6.49	14.83	21.32	-	N/A	-1.47	5.02	14.81	Pass
6365	SP	40	6.49	15.95	22.44	-	N/A	-0.41	6.08	17.14	Pass
6625	LPI	80	7.65	15.07	22.72	-	N/A	-3.83	3.82	5	Pass
6625	SP	80	7.65	15.40	23.05	-	N/A	-3.34	4.31	15.04	Pass
5985	SP	80	6.49	16.21	22.70	-	N/A	-2.88	3.61	11.81	Pass
6345	LPI	160	6.49	15.13	21.62	-	N/A	-7.15	-0.66	5	Pass
6025	SP	160	6.49	16.05	22.54	-	N/A	-6.09	0.40	8.31	Pass
6185	SP	160	6.49	16.13	22.62	-	N/A	-5.96	0.53	8.82	Pass

AFCD.USA: Unsuccessful spectrum access request

Freq. (MHz)	Mode (LPI or SP)	Bandwidth (MHz)	Antenna Gain (dBi)	Power (dBm)	EIRP (dBm)	AFC Response Limit (dBm)	Result	PSD (dBm/MHz)	EIRP PSD (dBm/MHz)	AFC Response Limit (dBm/MHz)	Result
6215	LPI	20	6.49	11.11	17.60	-	N/A	-1.69	4.80	5	Pass
6215	LPI	20	6.49	11.59	18.08	-	N/A	-1.62	4.87	5	Pass

AFCD.SAU: Successful spectrum access update

Freq. (MHz)	Mode (LPI or SP)	Bandwidth (MHz)	Antenna Gain (dBi)	Power (dBm)	EIRP (dBm)	AFC Response Limit (dBm)	Result	PSD (dBm/MHz)	EIRP PSD (dBm/MHz)	AFC Response Limit (dBm/MHz)	Result
6055	LPI	20	6.49	11.00	17.49	-	N/A	-1.95	4.54	5	Pass
6295	SP	20	6.49	13.52	20.01	-	N/A	0.22	6.71	20.63	Pass
6295	LPI	20	6.49	10.99	17.48	-	N/A	-2.33	4.16	5	Pass

AFCD.UAU: Unsuccessful spectrum access update

Freq. (MHz)	Mode (LPI or SP)	Bandwidth (MHz)	Antenna Gain (dBi)	Power (dBm)	EIRP (dBm)	AFC Response Limit (dBm)	Result	PSD (dBm/MHz)	EIRP PSD (dBm/MHz)	AFC Response Limit (dBm/MHz)	Result
6375	LPI	20	6.49	10.61	17.10	-	N/A	-2.68	3.81	5	Pass
5975	SP	20	6.49	12.09	18.58	-	N/A	0.73	7.22	23.00	Pass
5975	LPI	20	6.49	10.17	16.66	-	N/A	-2.54	3.95	5	Pass

AFC capability - Inquired Frequency

CT_AFC_SP_AP_AFCDRSA31_Frequency_20MHz_10611_1


Frequency (MHz): 6055

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6055MHz_TX

28/09/2023

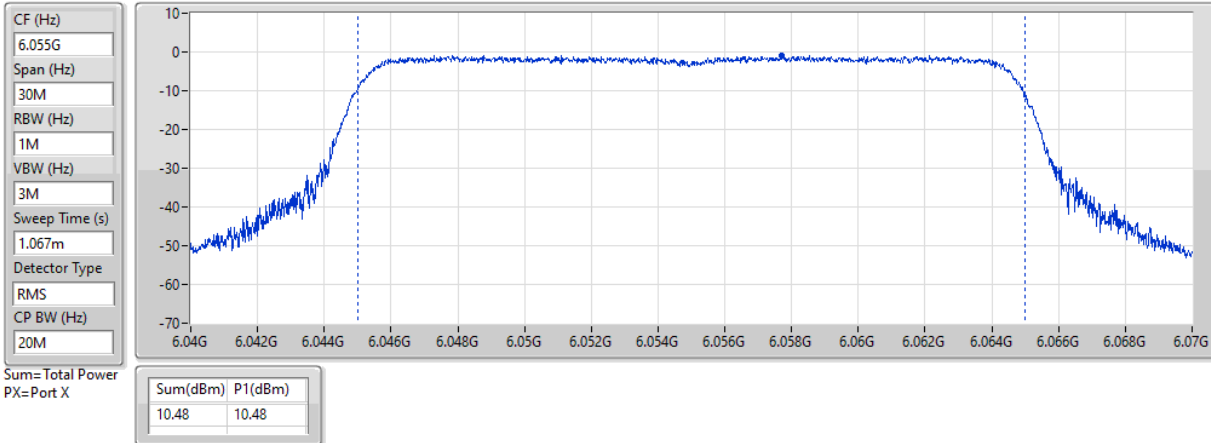


5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6055MHz

28/09/2023

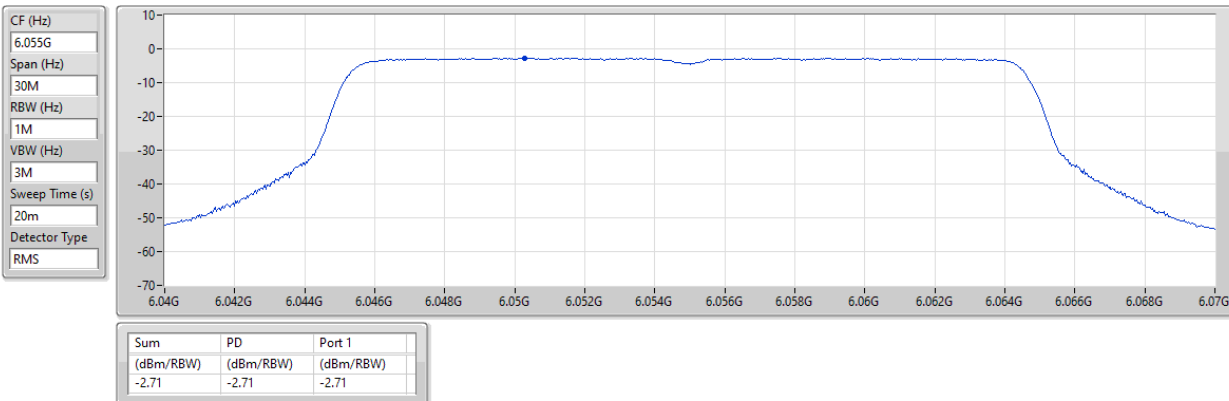

Frequency (MHz): 6695

6.525-6.875GHz_802.11ax HEW20_1TX


AV Power

6695MHz_TX

28/09/2023

CF (Hz)
6.695G
Span (Hz)
30M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
1.067m
Detector Type
RMS
CP BW (Hz)
20M

Sum=Total Power
PX=Port X

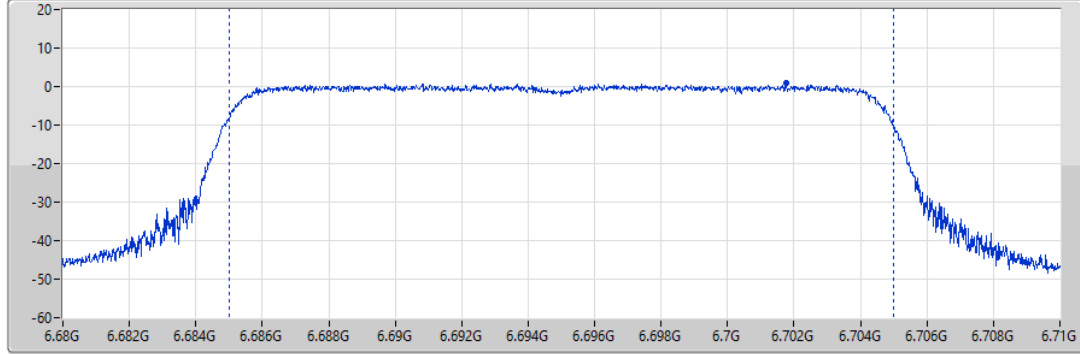

Port 1

Sum(dBm)	P1(dBm)
12.01	12.01


6.525-6.875GHz_802.11ax HEW20_1TX

PSD

6695MHz

28/09/2023

CF (Hz)
6.695G
Span (Hz)
30M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

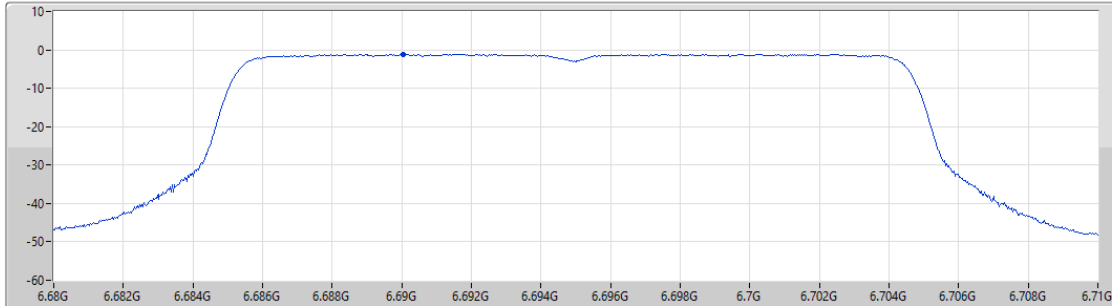

Port 1

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-1.11	-1.11	-1.11

Frequency (MHz): 5975


5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

5975MHz_TX

28/09/2023

CF (Hz)
5.975G
Span (Hz)
30M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
1.067m
Detector Type
RMS
CP BW (Hz)
20M

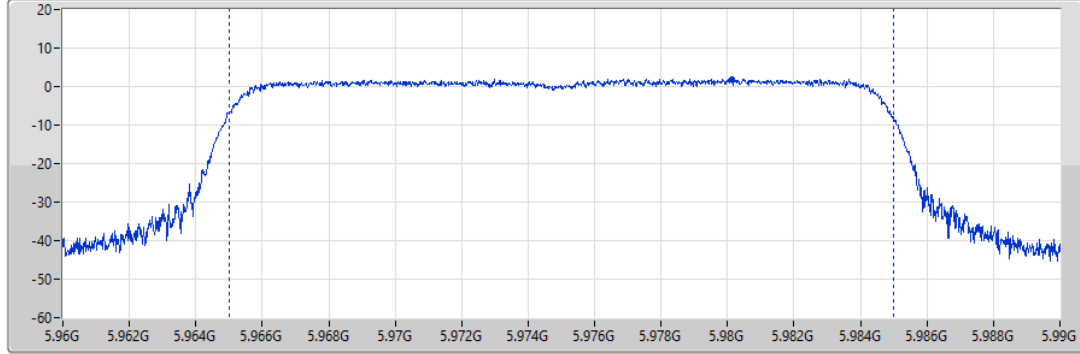

Port 1

Sum=Total Power
PX=Port X

Sum(dBm)	P1(dBm)
13.37	13.37


5.925-6.425GHz_802.11ax HEW20_1TX

PSD

5975MHz

28/09/2023

CF (Hz)
5.975G
Span (Hz)
30M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

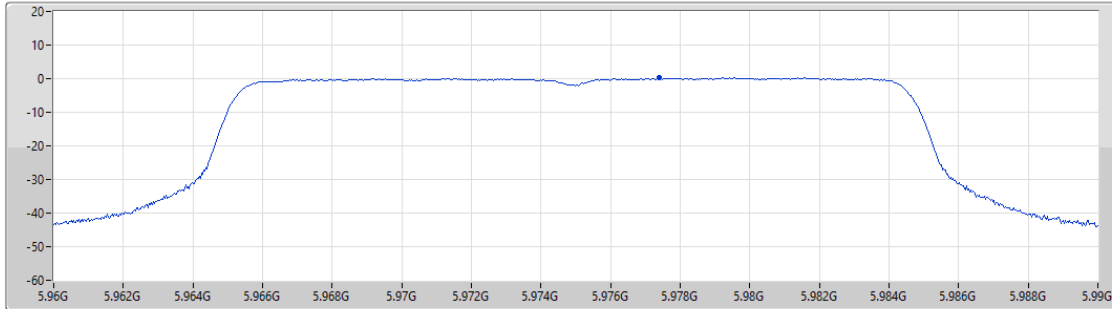

Port 1

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
0.32	0.32	0.32

CT_AFC_SP_AP_AFCRSA31_Frequency_40MHz_10612_1

Frequency (MHz): 5965

5.925-6.425GHz_802.11ax HEW40_1TX


AV Power

5965MHz_TX

28/09/2023

CF (Hz)
5.965G
Span (Hz)
60M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
1.067m
Detector Type
RMS
CP BW (Hz)
40M

Sum=Total Power
PX=Port X

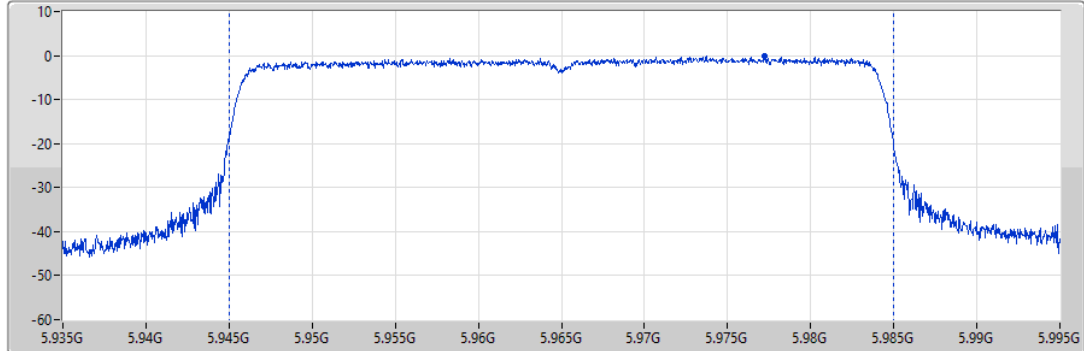

Port 1

Sum(dBm)	P1(dBm)
13.91	13.91


5.925-6.425GHz_802.11ax HEW40_1TX

PSD

5965MHz

28/09/2023

CF (Hz)
5.965G
Span (Hz)
60M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

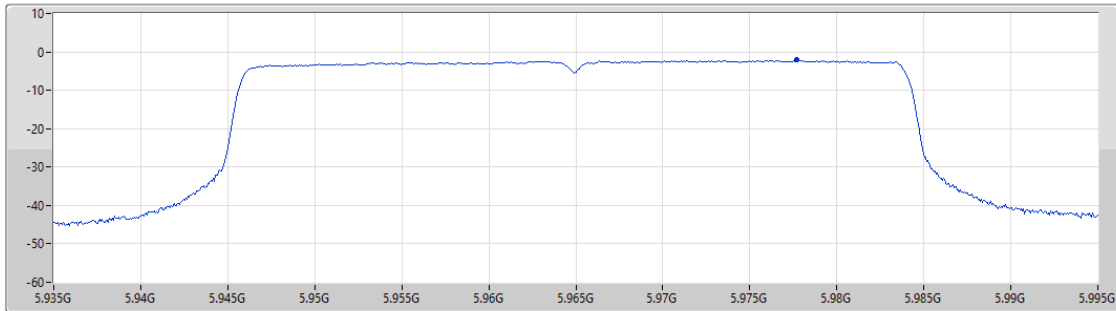

Port 1

Sum	PD	Port 1
(dBm/Hz)	(dBm/Hz)	(dBm/Hz)
-2.16	-2.16	-2.16

Frequency (MHz): 6125

5.925-6.425GHz_802.11ax HEW40_1TX


AV Power

6125MHz_TX

28/09/2023

CF (Hz)
6.125G
Span (Hz)
60M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
1.067m
Detector Type
RMS
CP BW (Hz)
40M

Sum=Total Power
PX=Port X

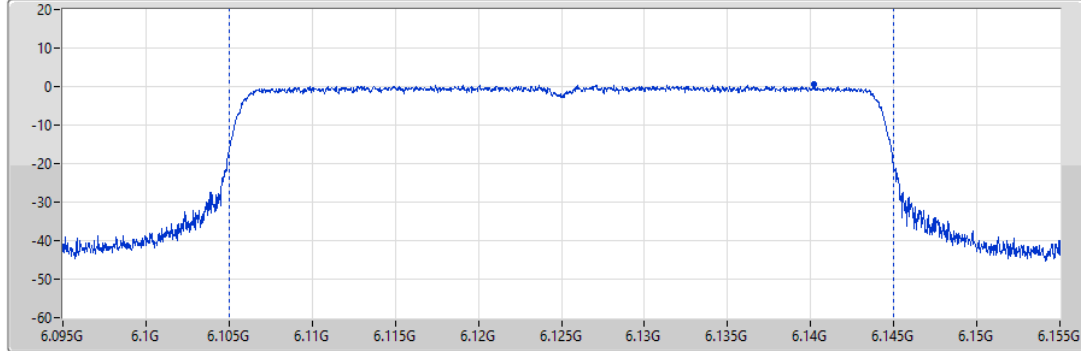

Port 1

Sum(dBm)	P1(dBm)
14.83	14.83


5.925-6.425GHz_802.11ax HEW40_1TX

PSD

6125MHz

28/09/2023

CF (Hz)
6.125G
Span (Hz)
60M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

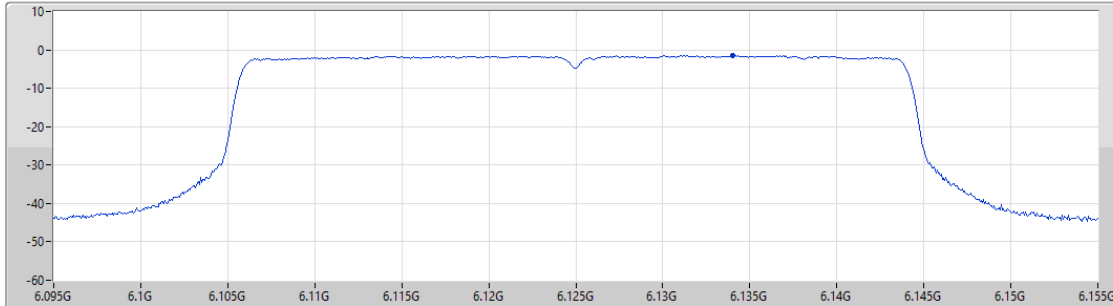

Port 1

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-1.47	-1.47	-1.47

Frequency (MHz): 6365

5.925-6.425GHz_802.11ax HEW40_1TX

AV Power

6365MHz_TX

28/09/2023

CF (Hz)
6.365G

Span (Hz)
60M


RBW (Hz)
1M

VBW (Hz)
3M

Sweep Time (s)
20m

Detector Type
RMS

CP BW (Hz)
40M

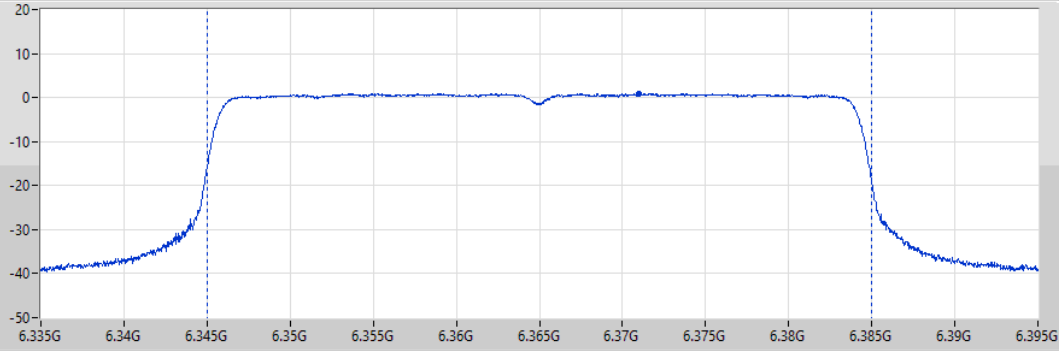

Port 1

Sum=Total Power
PX=Port X

Sum(dBm)	P1(dBm)
15.95	15.95

5.925-6.425GHz_802.11ax HEW40_1TX

PSD

6365MHz

28/09/2023

CF (Hz)
6.365G


Span (Hz)
60M

RBW (Hz)
1M

VBW (Hz)
3M

Sweep Time (s)
20m

Detector Type
RMS

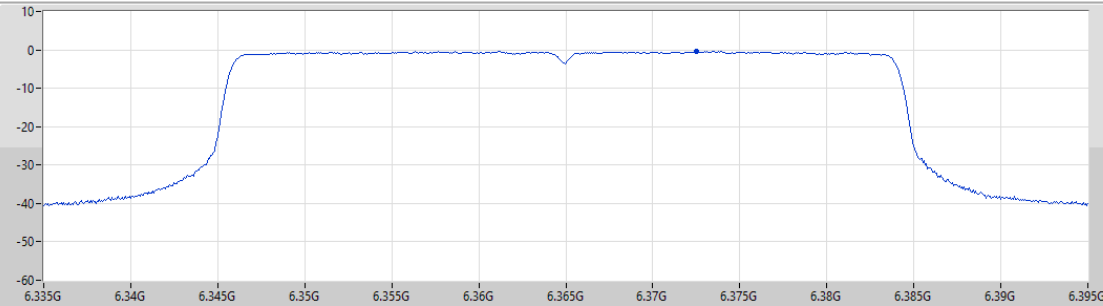

Port 1

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-0.41	-0.41	-0.41

CT_AFC_SP_AP_AFCRSA31_Frequency_80MHz_10613_1


Frequency (MHz): 6625

6.525-6.875GHz_802.11ax HEW80_1TX

AV Power

6625MHz_TX

04/10/2023

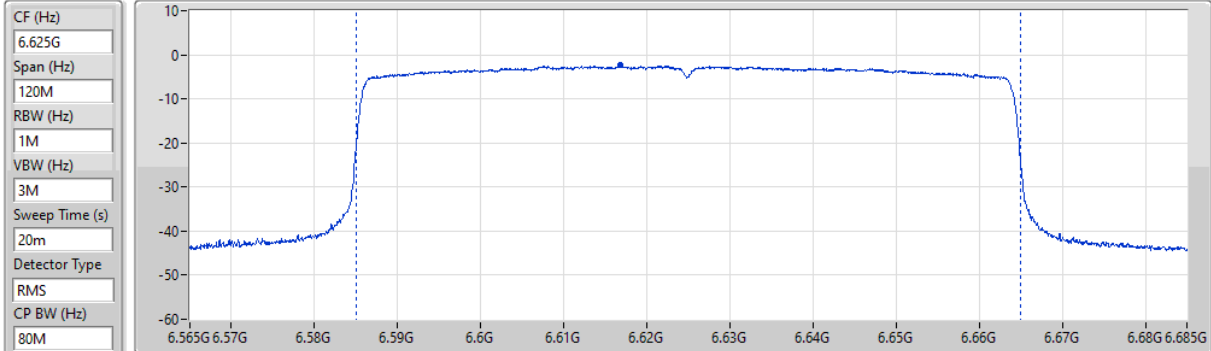

Port 1

Sum=Total Power
PX=Port X


Sum(dBm)	P1(dBm)
15.07	15.07

6.525-6.875GHz_802.11ax HEW80_1TX

PSD

6625MHz

04/10/2023

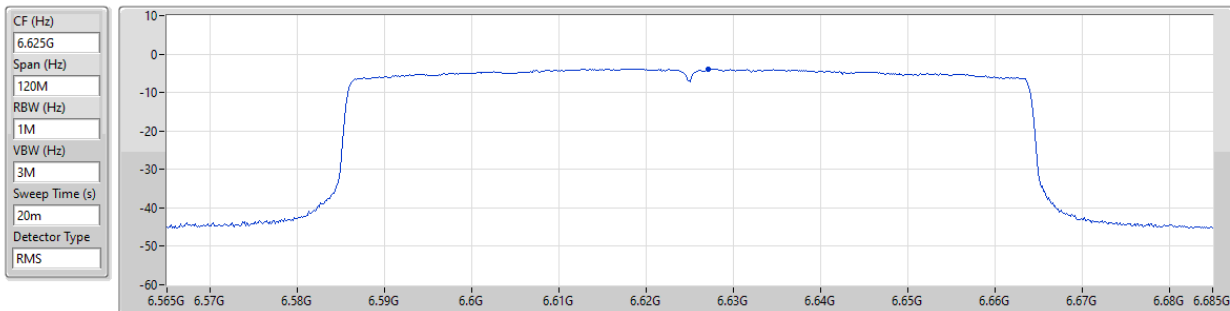

Port 1

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-3.83	-3.83	-3.83


Frequency (MHz): 6625

6.525-6.875GHz_802.11ax HEW80_1TX

AV Power

6625MHz_TX

04/10/2023

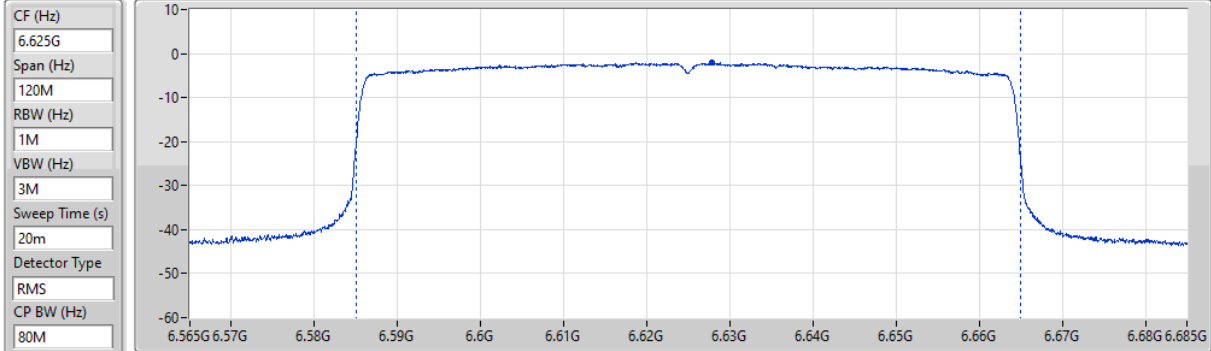


6.525-6.875GHz_802.11ax HEW80_1TX

PSD

6625MHz

04/10/2023

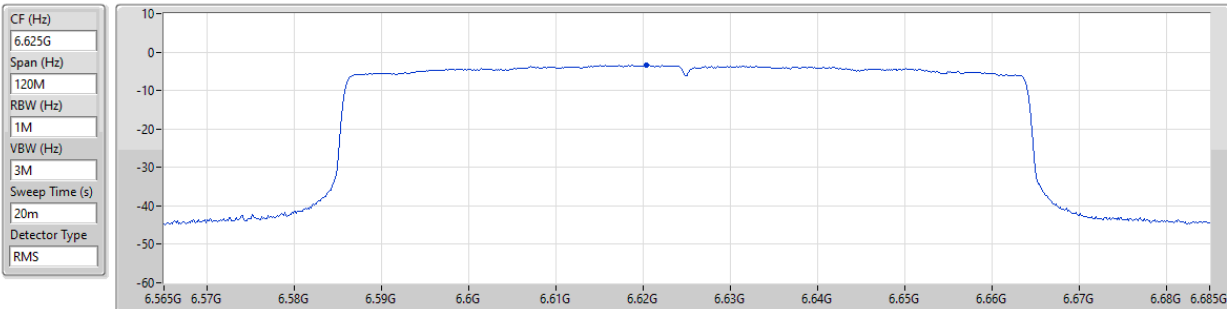

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-3.34	-3.34	-3.34

Frequency (MHz): 5985

5.925-6.425GHz_802.11ax HEW80_1TX


AV Power

5985MHz_TX

04/10/2023

CF (Hz)
5.985G
Span (Hz)
120M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS
CP BW (Hz)
80M

Sum=Total Power
PX=Port X

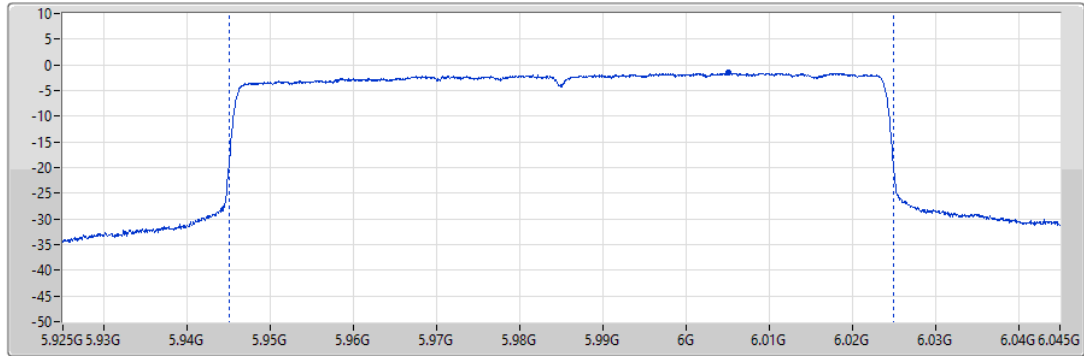

Port 1

Sum(dBm)	P1(dBm)
16.21	16.21


5.925-6.425GHz_802.11ax HEW80_1TX

PSD

5985MHz

04/10/2023

CF (Hz)
5.985G
Span (Hz)
120M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

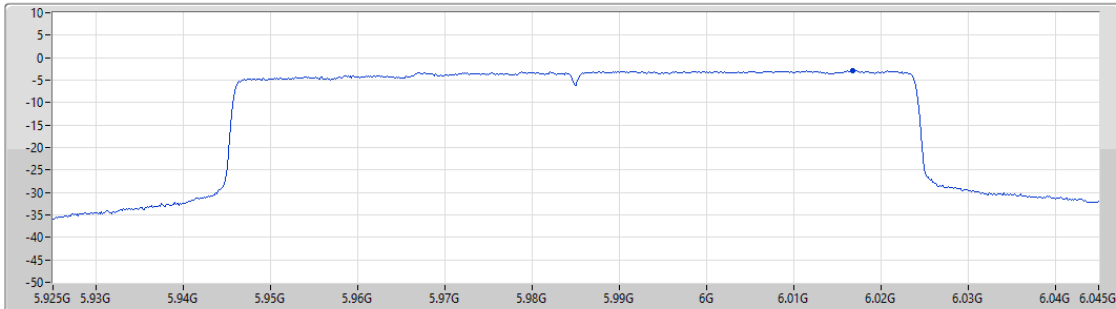

Port 1

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-2.88	-2.88	-2.88

CT_AFC_SP_AP_AFCDRSA31_Frequency_160MHz_10614_1

Frequency (MHz): 6345

5.925-6.425GHz_802.11ax HEW160_1TX


AV Power

6345MHz_TX

28/09/2023

CF (Hz)
6.345G
Span (Hz)
240M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
1.067m
Detector Type
RMS
CP BW (Hz)
160M

Sum=Total Power
PX=Port X

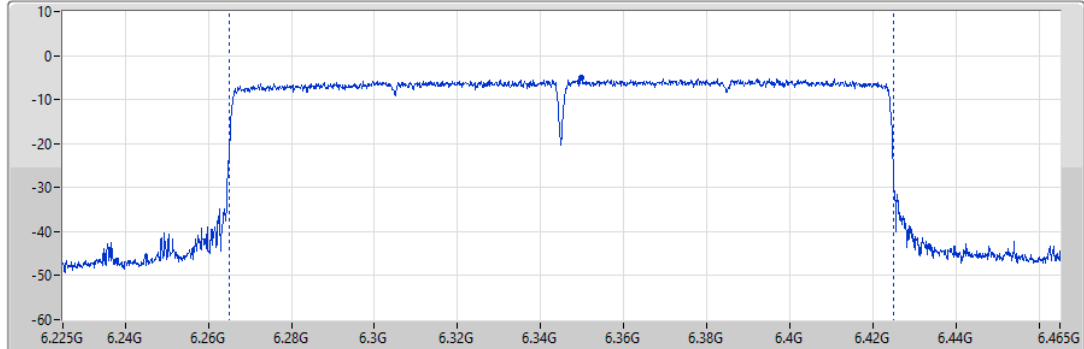

Port 1

Sum(dBm)	P1(dBm)
15.13	15.13


5.925-6.425GHz_802.11ax HEW160_1TX

PSD

6345MHz

28/09/2023

CF (Hz)
6.345G
Span (Hz)
240M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

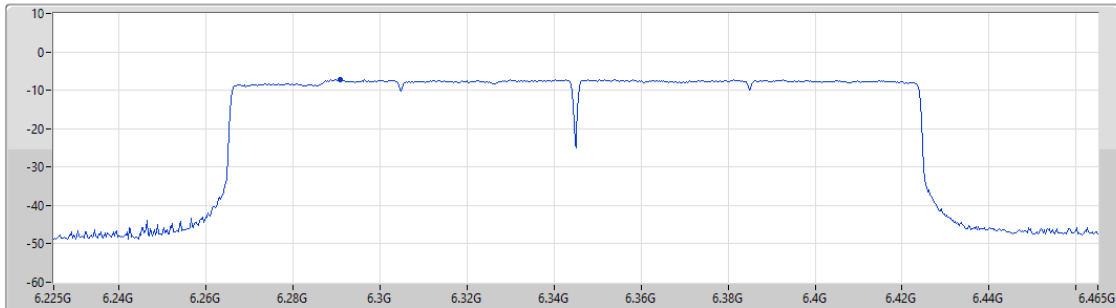

Port 1

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-7.15	-7.15	-7.15


Frequency (MHz): 6025

5.925-6.425GHz_802.11ax HEW160_1TX

AV Power

6025MHz_TX

28/09/2023

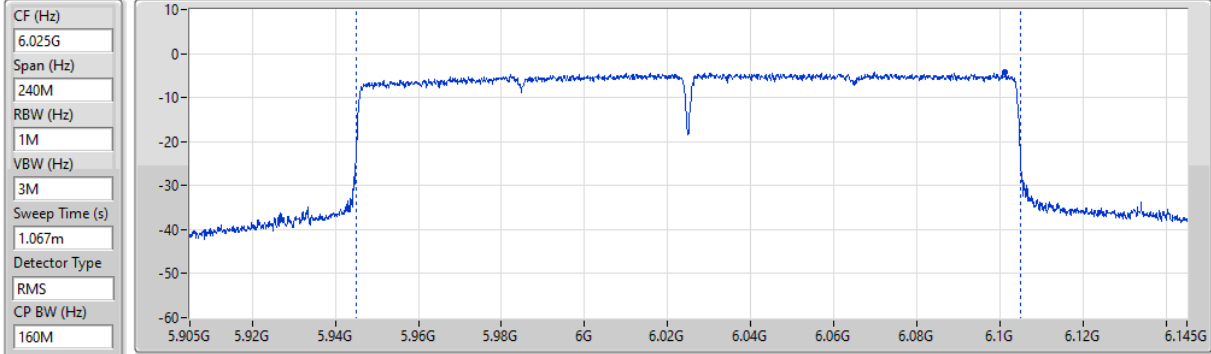

Sum=Total Power
PX=Port X


Sum(dBm)	P1(dBm)
16.05	16.05

5.925-6.425GHz_802.11ax HEW160_1TX

PSD

6025MHz

28/09/2023

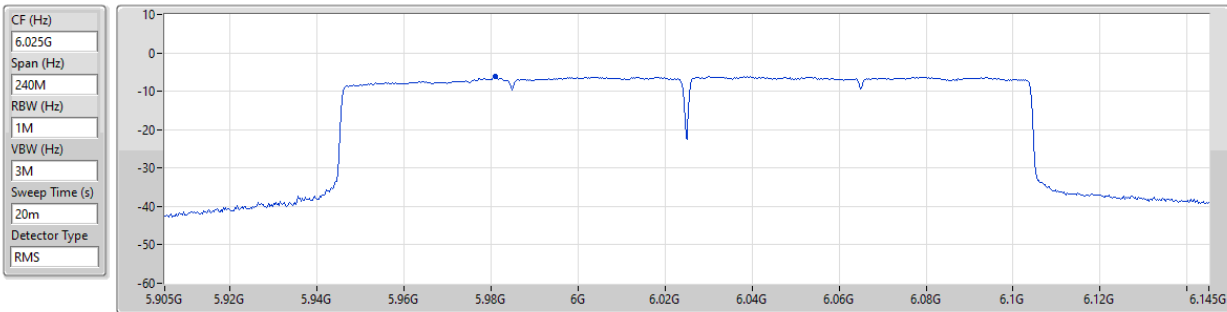

Sum	PD	Port 1
(dBm/RBW)	(dBm/RBW)	(dBm/RBW)
-6.09	-6.09	-6.09


Frequency (MHz): 6185

5.925-6.425GHz_802.11ax HEW160_1TX

AV Power

6185MHz_TX

28/09/2023

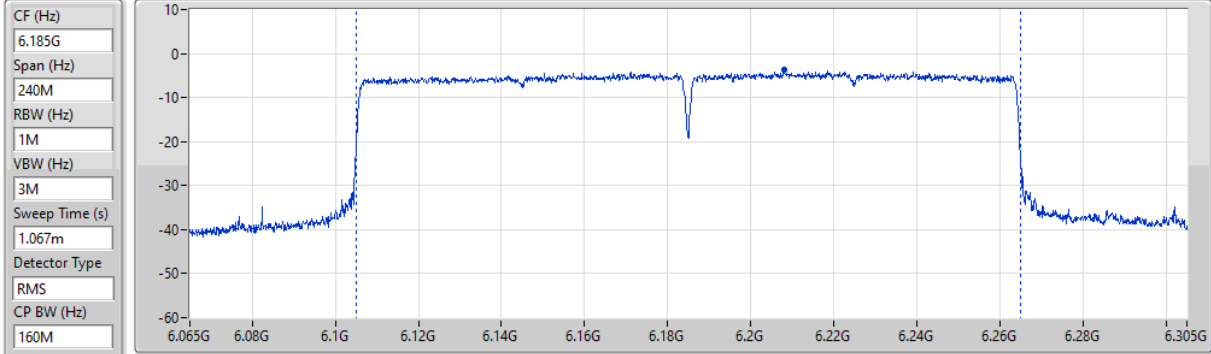


5.925-6.425GHz_802.11ax HEW160_1TX

PSD

6185MHz

28/09/2023

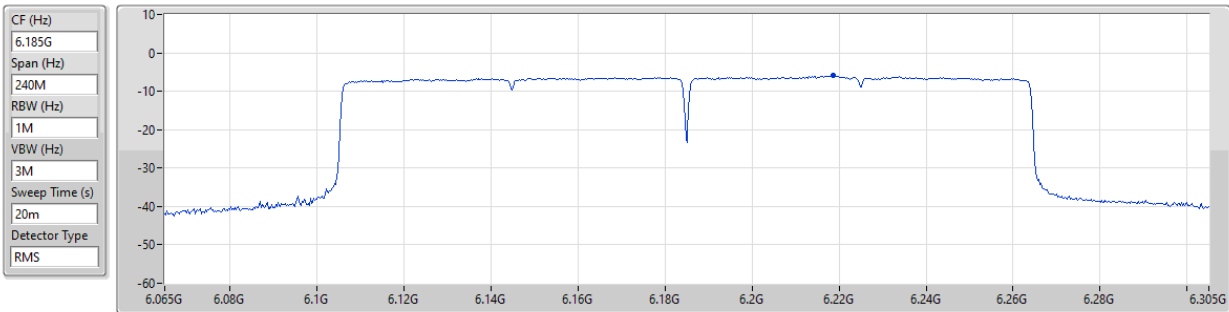

Sum	PD	Port 1
(dBm/Hz)	(dBm/Hz)	(dBm/Hz)
-5.96	-5.96	-5.96

CT_AFC_SP_AP_AFCUSA32_Frequency_10615_1

Bandwidth: 20MHz


Frequency (MHz): 6215

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6215MHz_TX

28/09/2023

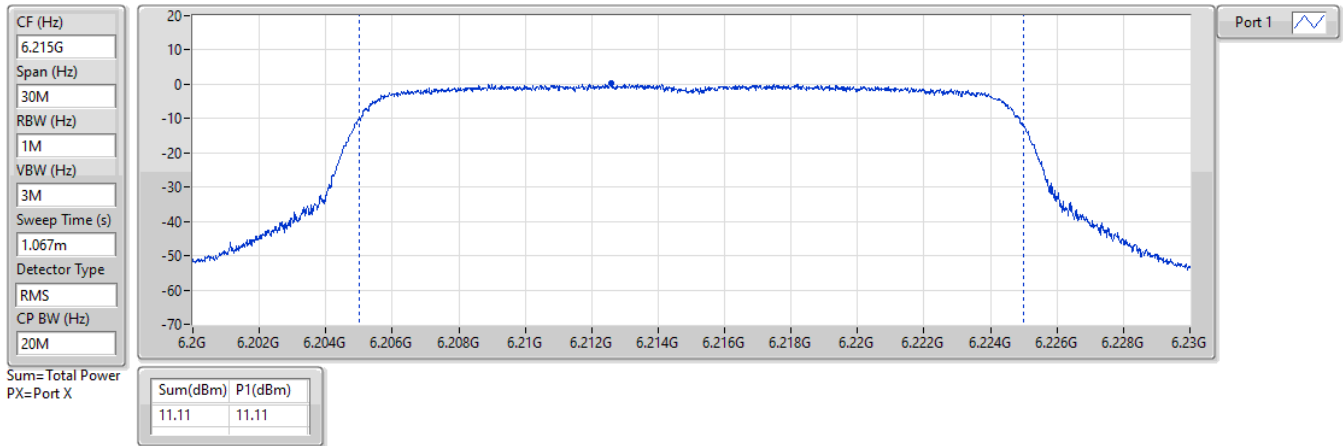


5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6215MHz

28/09/2023

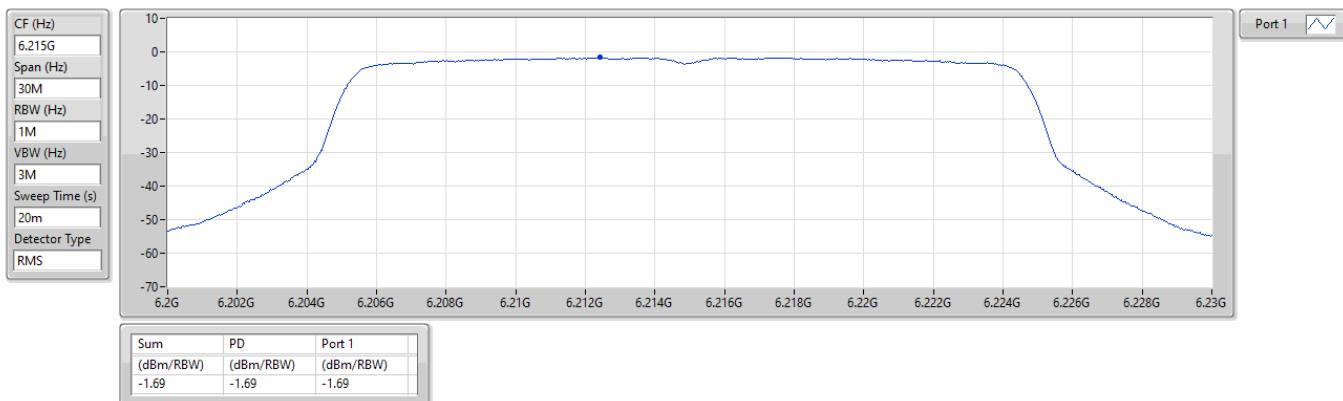


Frequency (MHz): 6215

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6215MHz_TX

28/09/2023

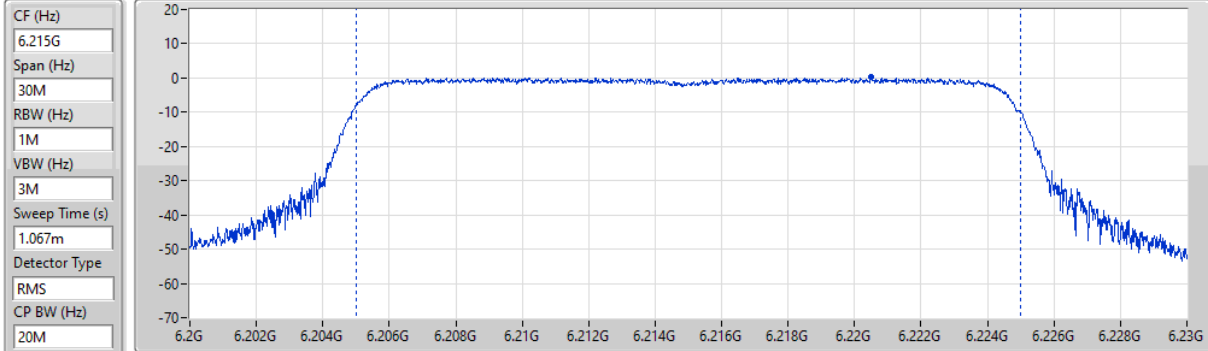


5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6215MHz

28/09/2023

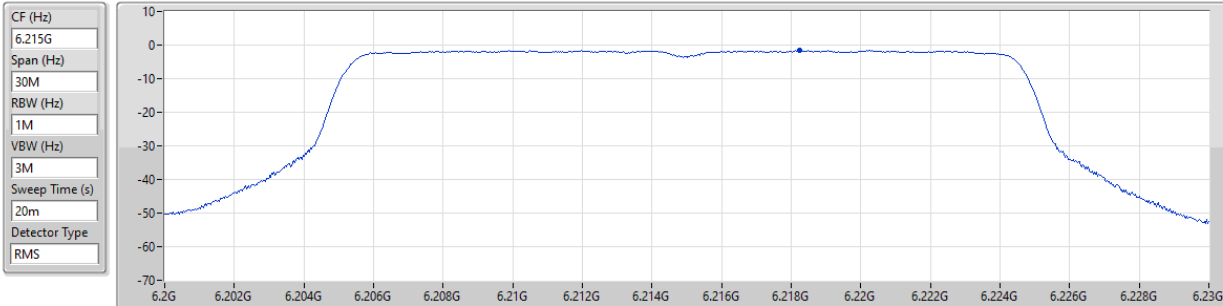

CT_AFC_SP_AP_AFCDSAU33_Frequency_10616_1

Bandwidth: 20MHz

Frequency (MHz): 6055

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6055MHz_TX

28/09/2023

CF (Hz)
6.055G

Span (Hz)
30M


RBW (Hz)
1M

VBW (Hz)
3M

Sweep Time (s)
20m

Detector Type
RMS

CP BW (Hz)
20M

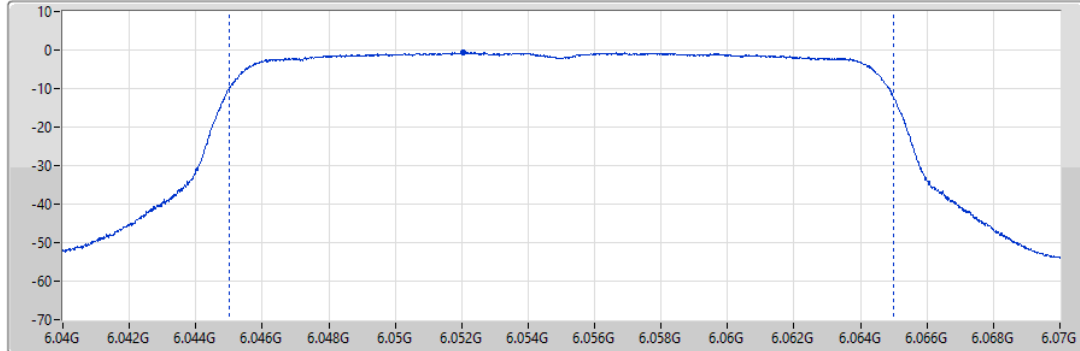

Port 1

Sum= Total Power
PX=Port X

Sum(dBm)	P1(dBm)
11.00	11.00

5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6055MHz

28/09/2023

CF (Hz)
6.055G


Span (Hz)
30M

RBW (Hz)
1M

VBW (Hz)
3M


Sweep Time (s)
20m


Detector Type
RMS

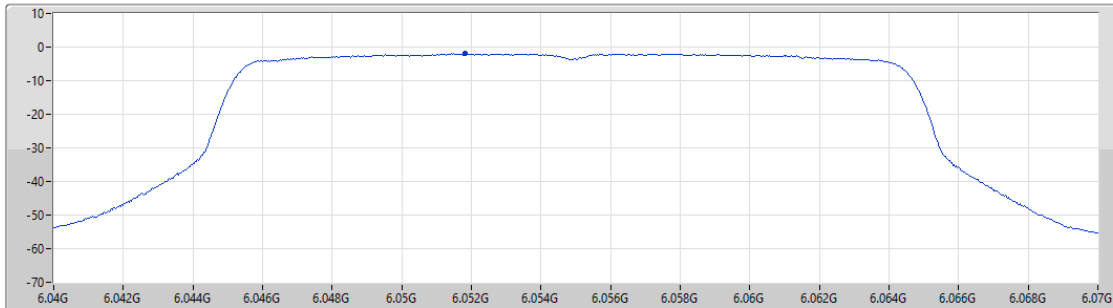

Port 1

Sum (dBm/RBW)	PD (dBm/RBW)	Port 1 (dBm/RBW)
-1.95	-1.95	-1.95

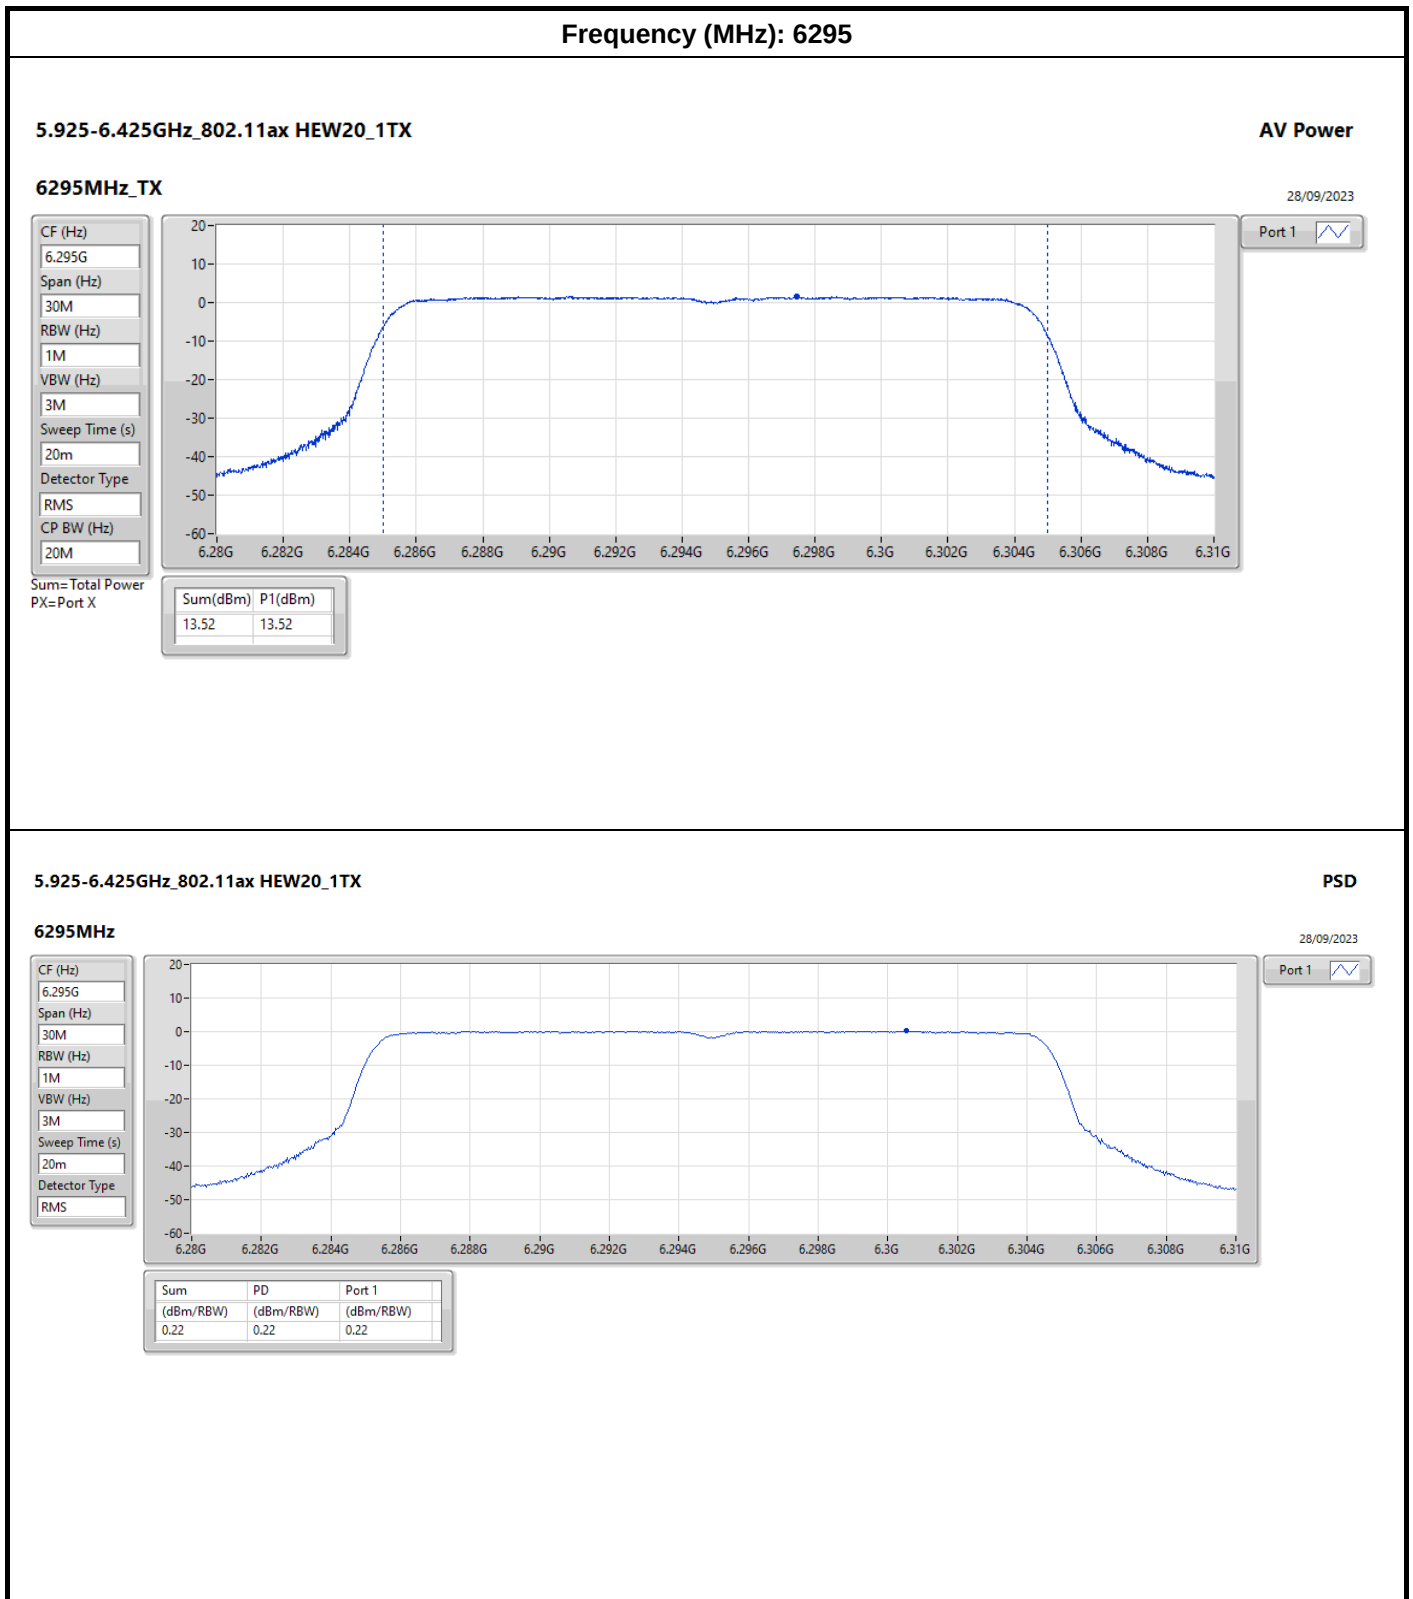

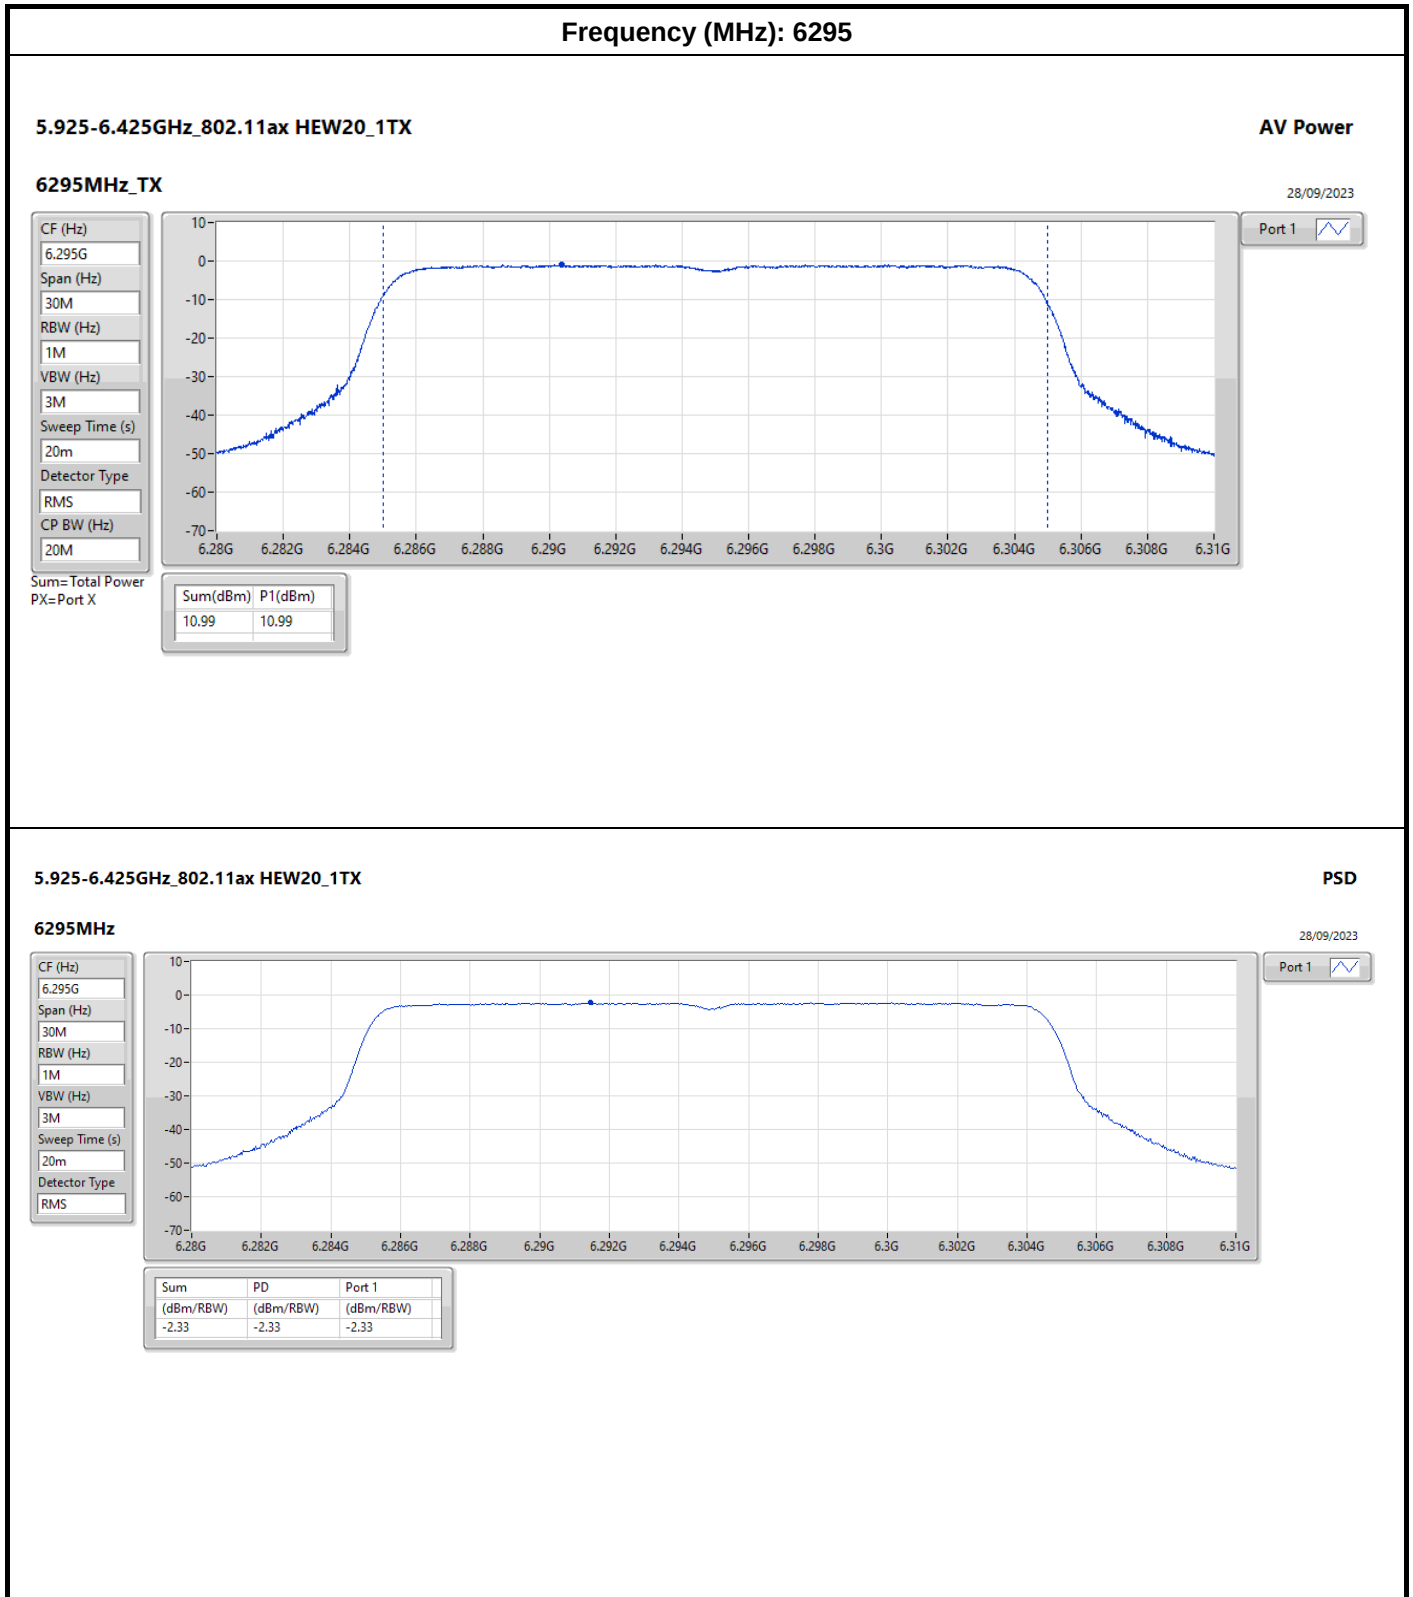

5.925-6.425GHz_802.11ax HEW20_1TX

PSD

CF (Hz)
6.295G


Span (Hz)
30M

RBW (Hz)
1M

VBW (Hz)
3M

Sweep Time (s)
20m

Detector Type
RMS

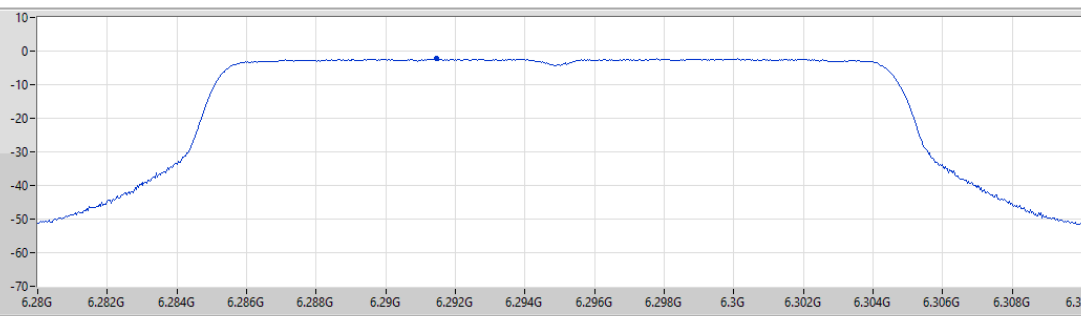

Sum	PD	Port 1
(dBm/Hz)	(dBm/Hz)	(dBm/Hz)
-2.33	-2.33	-2.33

CT_AFC_SP_AP_AFCDUAU34_Frequency_10617_1

Bandwidth: 20MHz


Frequency (MHz): 6375

5.925-6.425GHz_802.11ax HEW20_1TX

AV Power

6375MHz_TX

28/09/2023

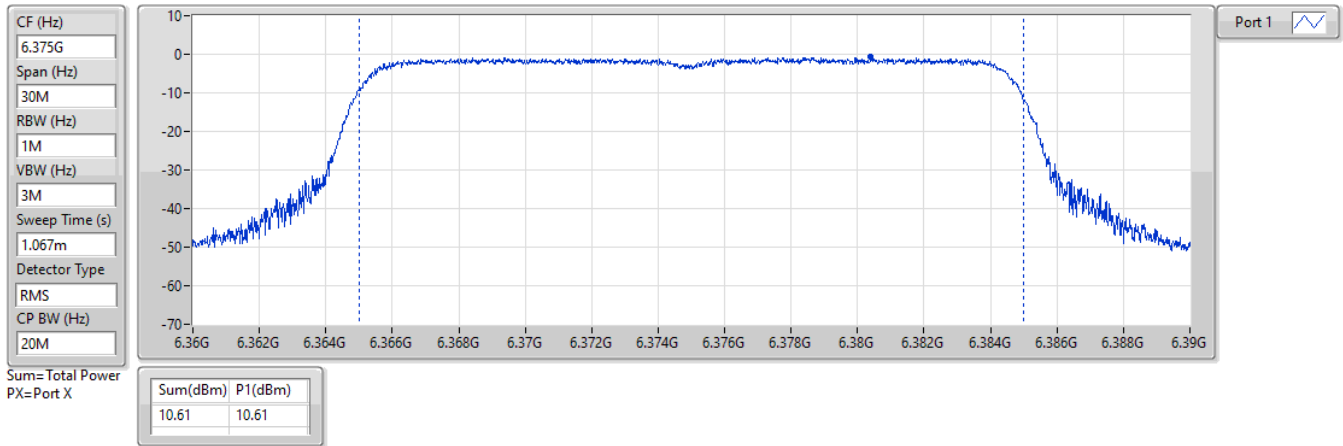



5.925-6.425GHz_802.11ax HEW20_1TX

PSD

6375MHz

28/09/2023

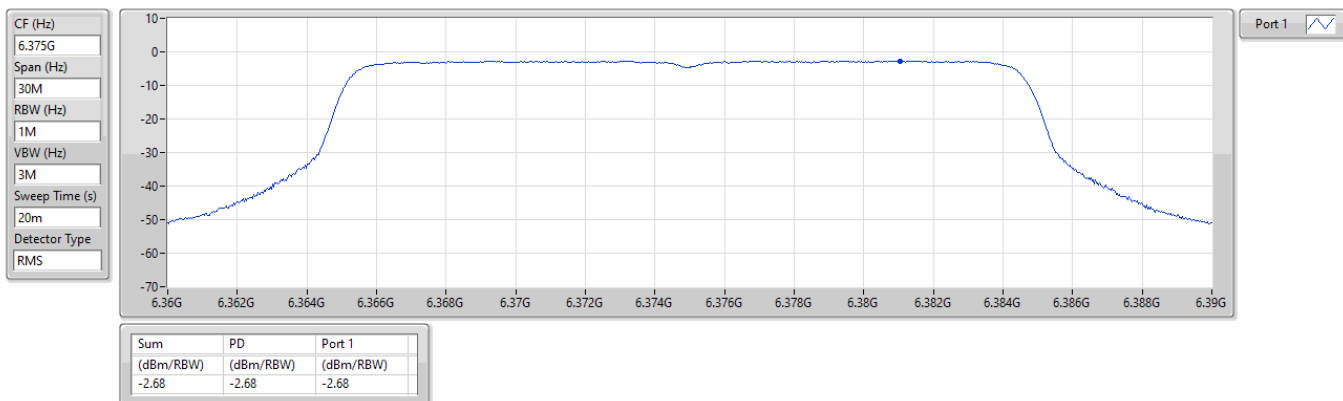

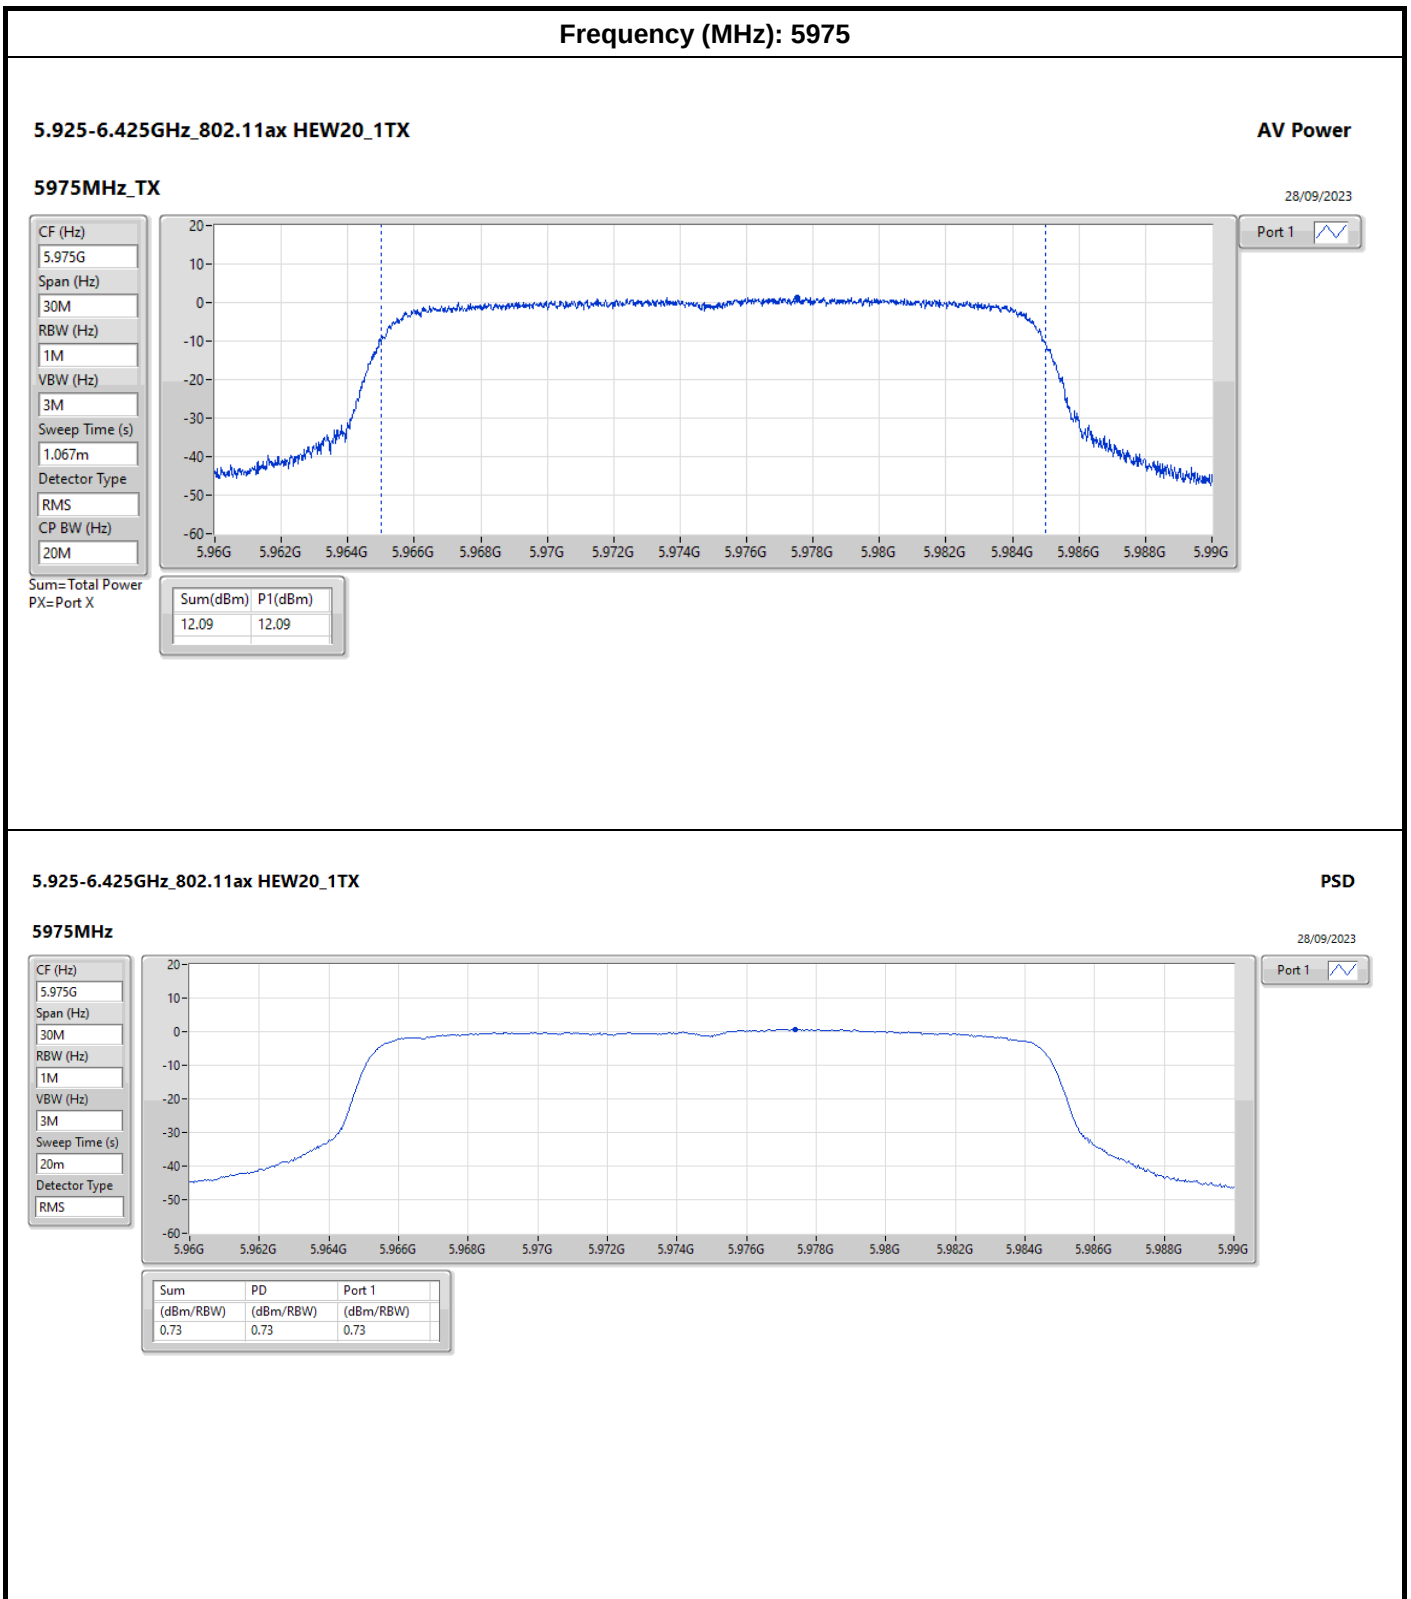

Frequency (MHz): 5975

5.925-6.425GHz_802.11ax HEW20_1TX


AV Power

5975MHz_TX

28/09/2023

CF (Hz)
5.975G
Span (Hz)
30M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
1.067m
Detector Type
RMS
CP BW (Hz)
20M

Sum=Total Power
PX=Port X

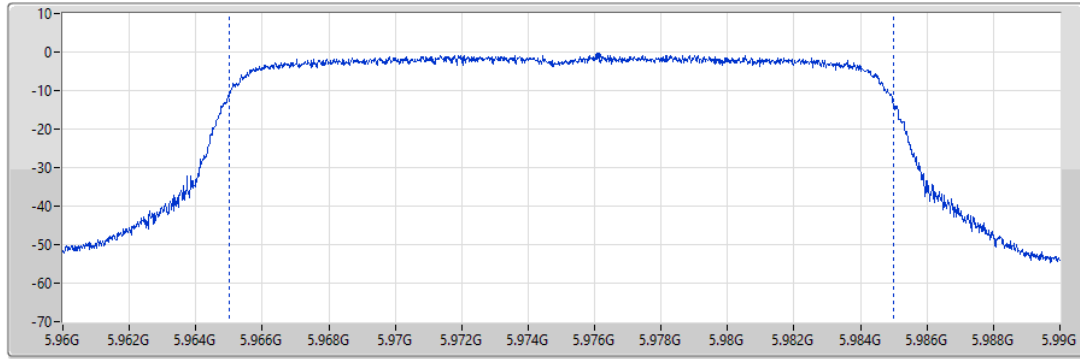

Port 1


5.925-6.425GHz_802.11ax HEW20_1TX

PSD

5975MHz

28/09/2023

CF (Hz)
5.975G
Span (Hz)
30M
RBW (Hz)
1M
VBW (Hz)
3M
Sweep Time (s)
20m
Detector Type
RMS

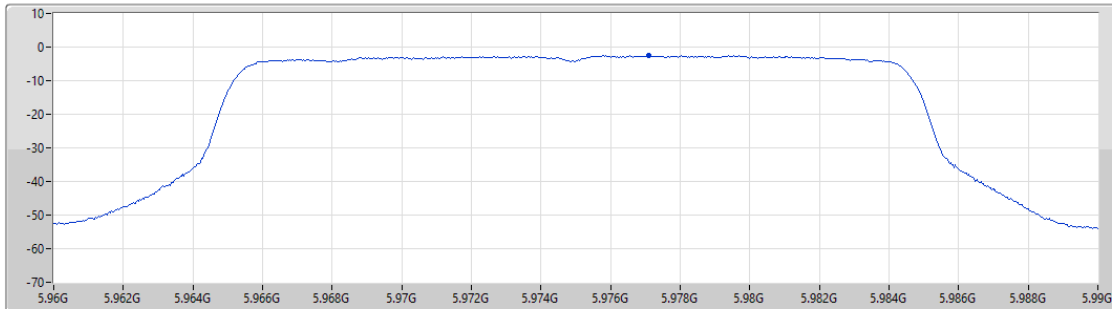


Port 1

Duty Cycle


Bandwidth: 20MHz

DC;ax20;BWch:20

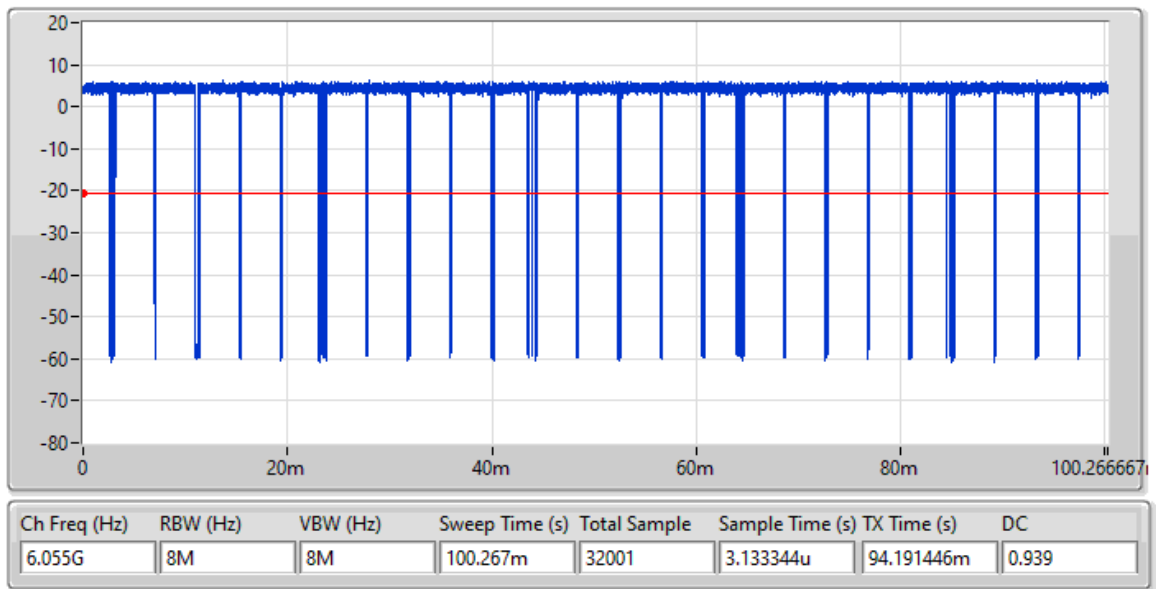


Bandwidth: 40MHz

DC;ax40;BWch:40

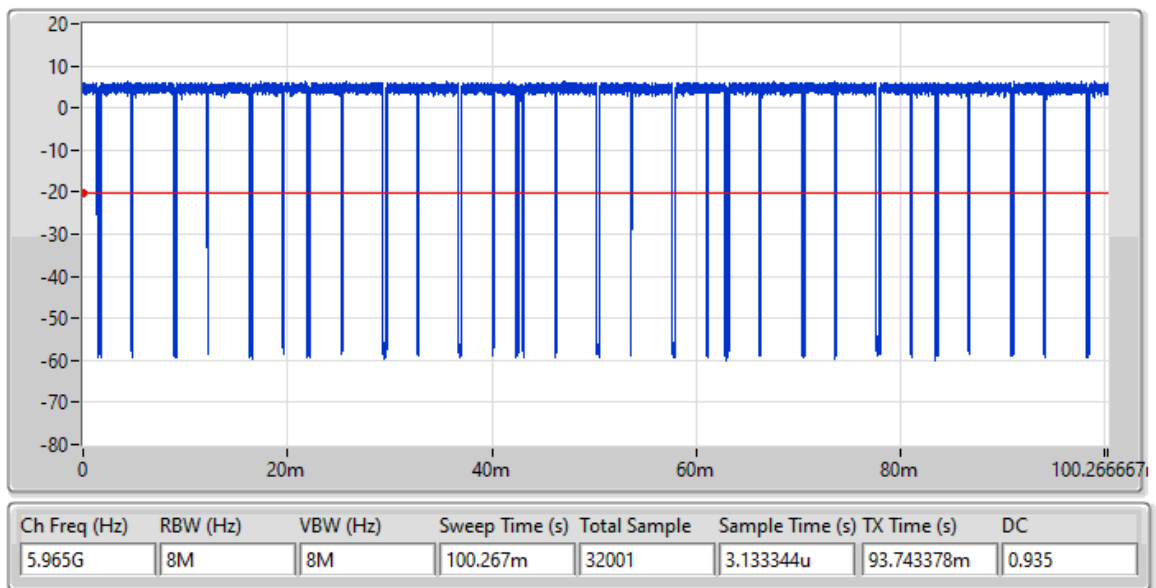


Bandwidth: 80MHz

DC;ax80;BWch:80

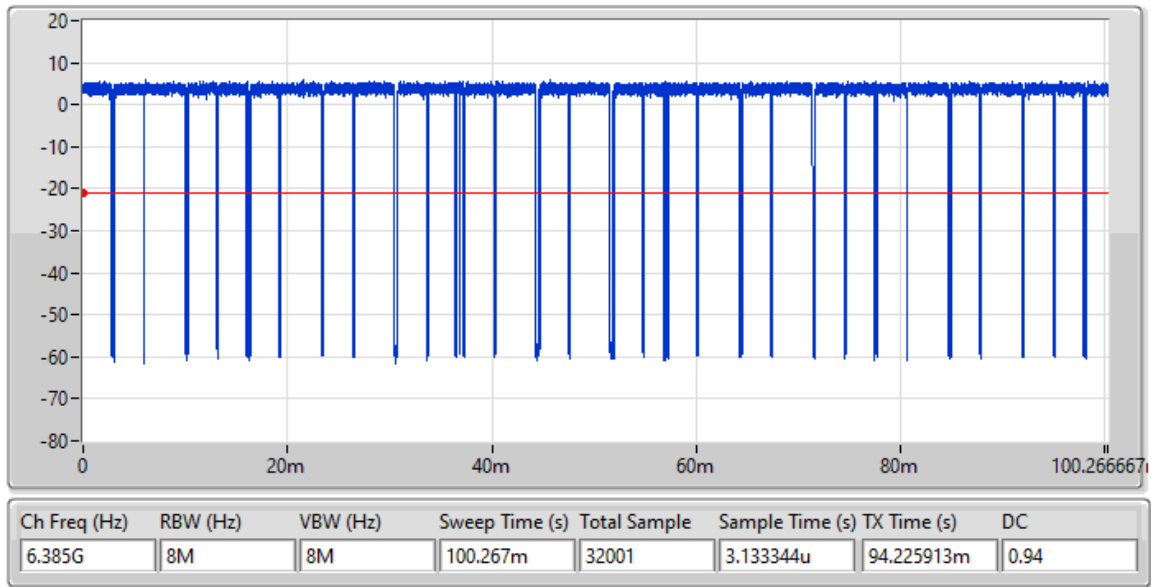

Bandwidth: 160MHz

DC;ax160;BWch:160

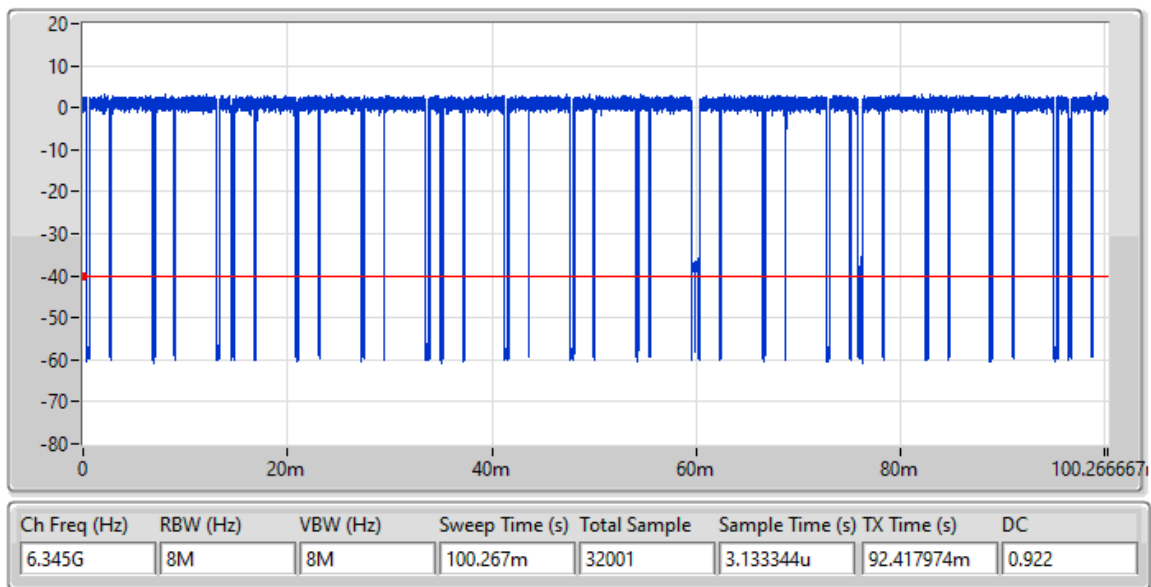

—THE END—