



Intertek Testing Services ETL SEMKO

Report No.: 9912976

Tested By: Hong, Report No.: 9912976

Scan Settings (1 Range)

Frequencies			Receiver Settings					
Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF	60dB


Final Measurement: x QP

Meas Time: 1 s

Subranges: 16

Acc Margin: 20dB

Transducer No.	Start	Stop	Name
3	9k	30M	EI078

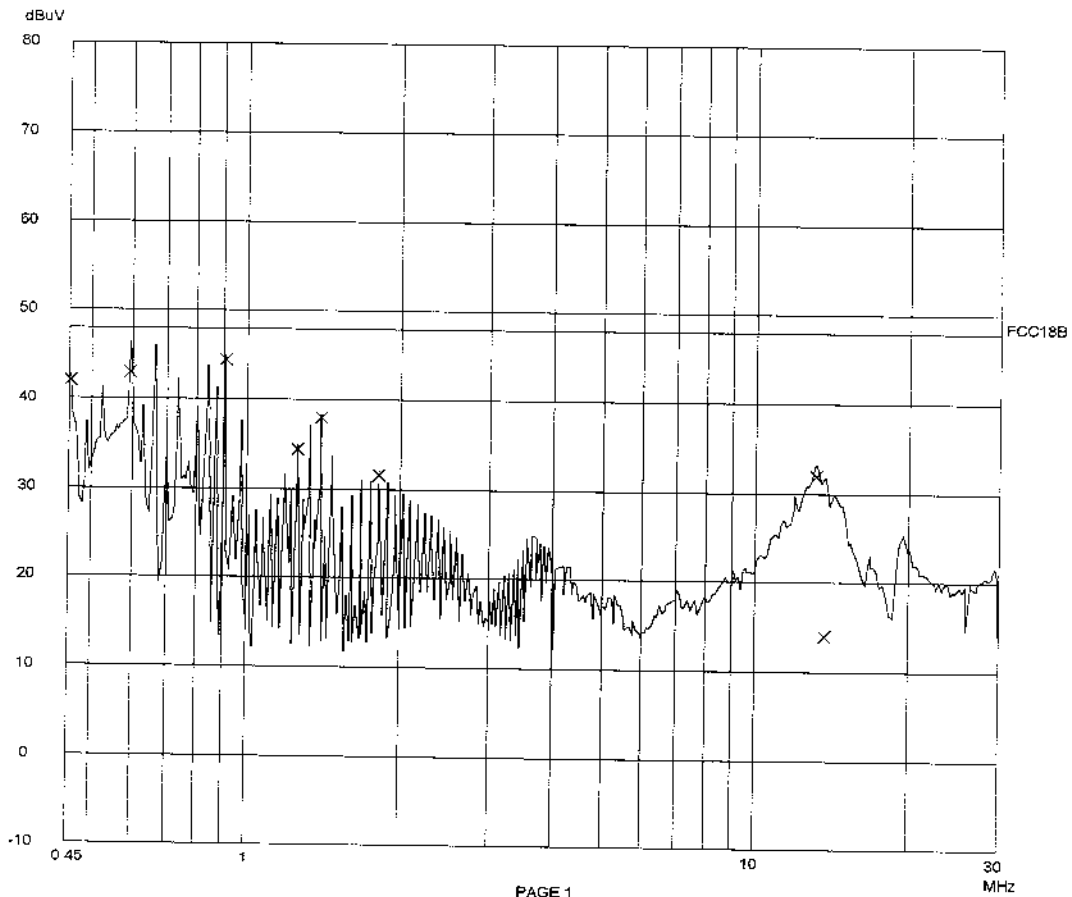

Ctrl No.: N/A



Intertek Testing Services

ETL SEMKO

Report No.: 9912976

Tested By: Hong, Report No.: 9912976

Scan Settings (1 Range)

|----- Frequencies -----||----- Receiver Settings -----|

Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
450k	30M	5k	10k	PK	20ms	AUTO	LN OFF	60dB

Final Measurement Results:

Frequency	QP Level	QP Limit
MHz	dBuV	dBuV

0.45500	42.0	48.0
0.59500	42.9	48.0
0.91000	44.5	48.0
1.26000	34.4	48.0
1.40000	37.9	48.0
1.82000	31.5	48.0
13.14500	31.9	48.0
13.70000	13.9	48.0

* limit exceeded

Ctrl No.: N/A