

Appendix Test Data

Report No.:	1812C60388012502-01	Test Sample No.:	1-2-2
Start Test Date:	2026-7-16	Finish Test Date:	2026-7-24
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	24°C	Relative Humidity:	64%
Pressure:	99.9kPa		



Appendix A: 6dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	6dB BW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
BLE_1M	Ant1	2402	0.644	2401.676	2402.320	0.5	PASS
BLE_1M	Ant2	2402	0.652	2401.668	2402.320	0.5	PASS
BLE_1M	Ant1	2440	0.648	2439.680	2440.328	0.5	PASS
BLE_1M	Ant2	2440	0.660	2439.668	2440.328	0.5	PASS
BLE_1M	Ant1	2480	0.660	2479.664	2480.324	0.5	PASS
BLE_1M	Ant2	2480	0.648	2479.660	2480.308	0.5	PASS
BLE_2M	Ant1	2402	1.220	2401.368	2402.588	0.5	PASS
BLE_2M	Ant2	2402	1.364	2401.320	2402.684	0.5	PASS
BLE_2M	Ant1	2440	1.072	2439.464	2440.536	0.5	PASS
BLE_2M	Ant2	2440	1.116	2439.428	2440.544	0.5	PASS
BLE_2M	Ant1	2480	1.108	2479.444	2480.552	0.5	PASS
BLE_2M	Ant2	2480	1.276	2479.372	2480.648	0.5	PASS

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
BLE_1M	Ant1	2402	1.0421	2401.4853	2402.5274	---	---
BLE_1M	Ant2	2402	1.0372	2401.4803	2402.5175	---	---
BLE_1M	Ant1	2440	1.0497	2439.4825	2440.5322	---	---
BLE_1M	Ant2	2440	1.0376	2439.4789	2440.5165	---	---
BLE_1M	Ant1	2480	1.0450	2479.4835	2480.5285	---	---
BLE_1M	Ant2	2480	1.0267	2479.4803	2480.5070	---	---
BLE_2M	Ant1	2402	2.0543	2400.9905	2403.0448	---	---
BLE_2M	Ant2	2402	2.0675	2400.9868	2403.0543	---	---
BLE_2M	Ant1	2440	2.0577	2438.9944	2441.0521	---	---
BLE_2M	Ant2	2440	2.0321	2438.9909	2441.0230	---	---
BLE_2M	Ant1	2480	2.0413	2478.9999	2481.0412	---	---
BLE_2M	Ant2	2480	2.0602	2478.9793	2481.0395	---	---

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: Maximum conducted output power

Test Result Peak

Test Mode	Antenna	Frequency [MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
BLE_1M	Ant1	2402	3.39	≤30	PASS
BLE_1M	Ant2	2402	3.04	≤30	PASS
BLE_1M	Ant1	2440	3.38	≤30	PASS
BLE_1M	Ant2	2440	3.26	≤30	PASS
BLE_1M	Ant1	2480	3.67	≤30	PASS
BLE_1M	Ant2	2480	3.27	≤30	PASS
BLE_2M	Ant1	2402	3.36	≤30	PASS
BLE_2M	Ant2	2402	3.22	≤30	PASS
BLE_2M	Ant1	2440	3.30	≤30	PASS
BLE_2M	Ant2	2440	3.39	≤30	PASS
BLE_2M	Ant1	2480	3.62	≤30	PASS
BLE_2M	Ant2	2480	3.39	≤30	PASS


Test Graphs Peak

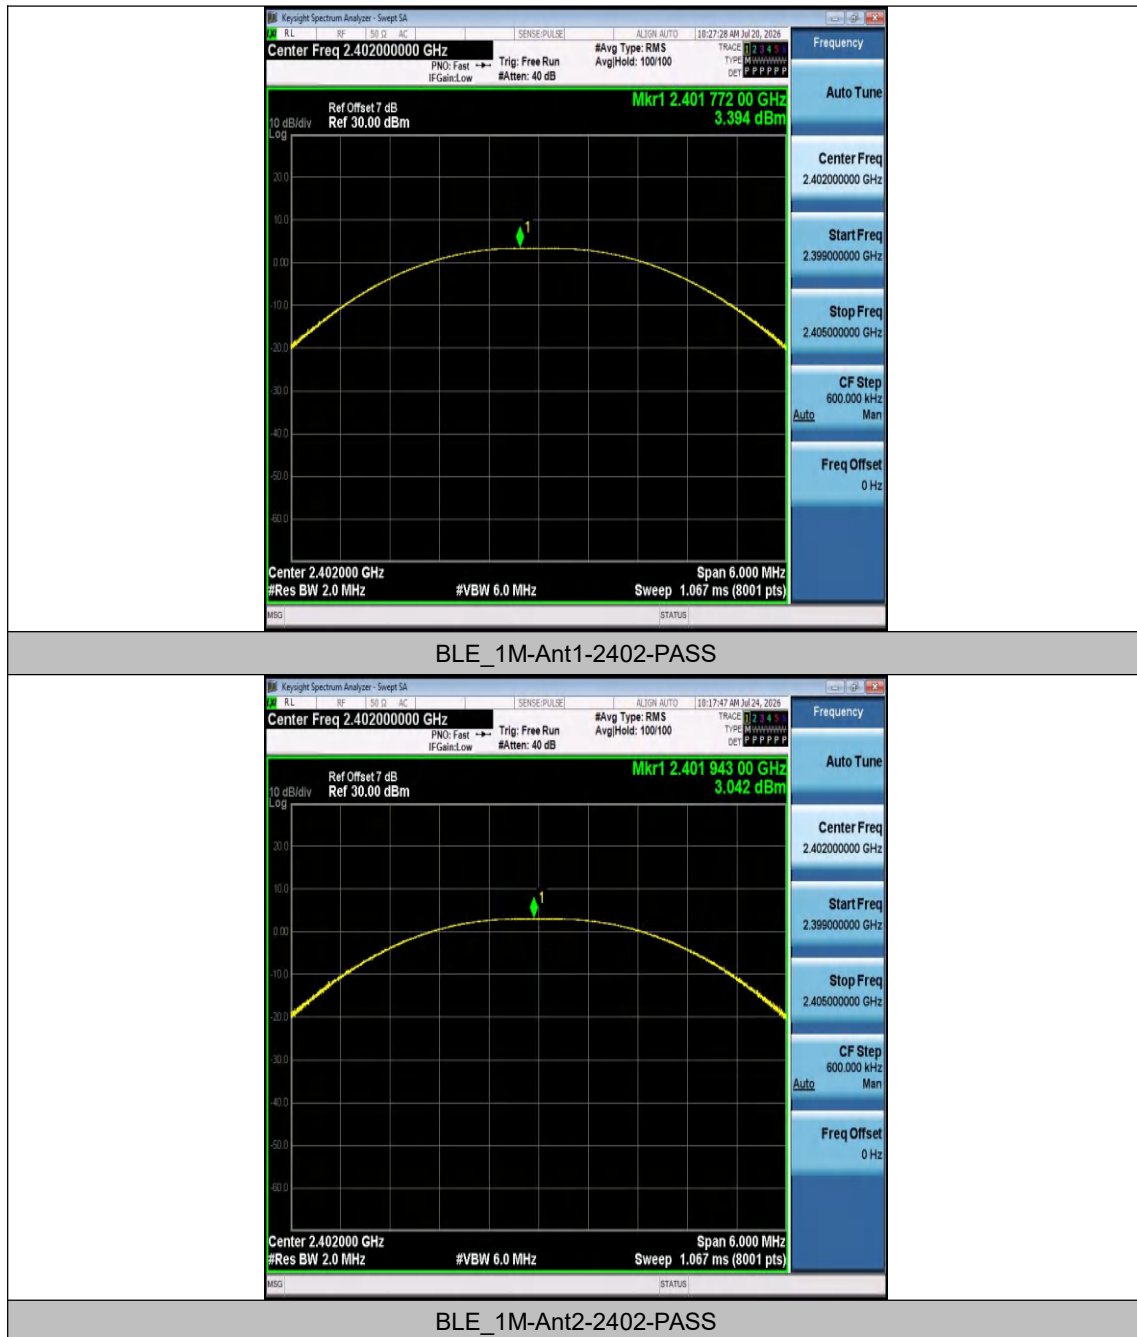

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

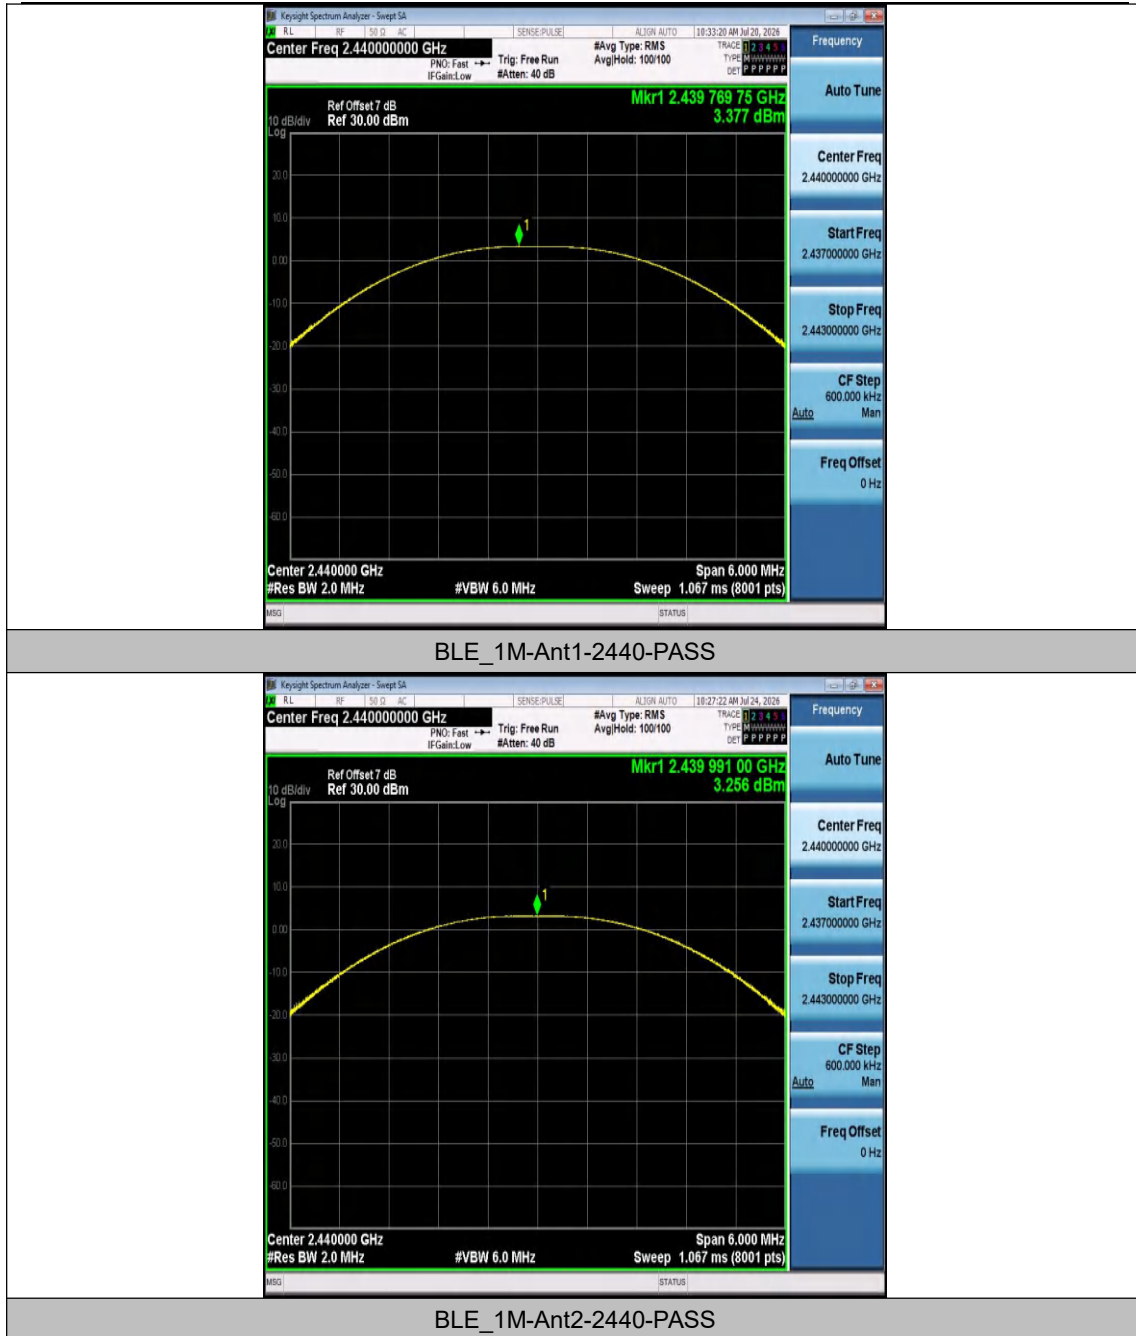

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

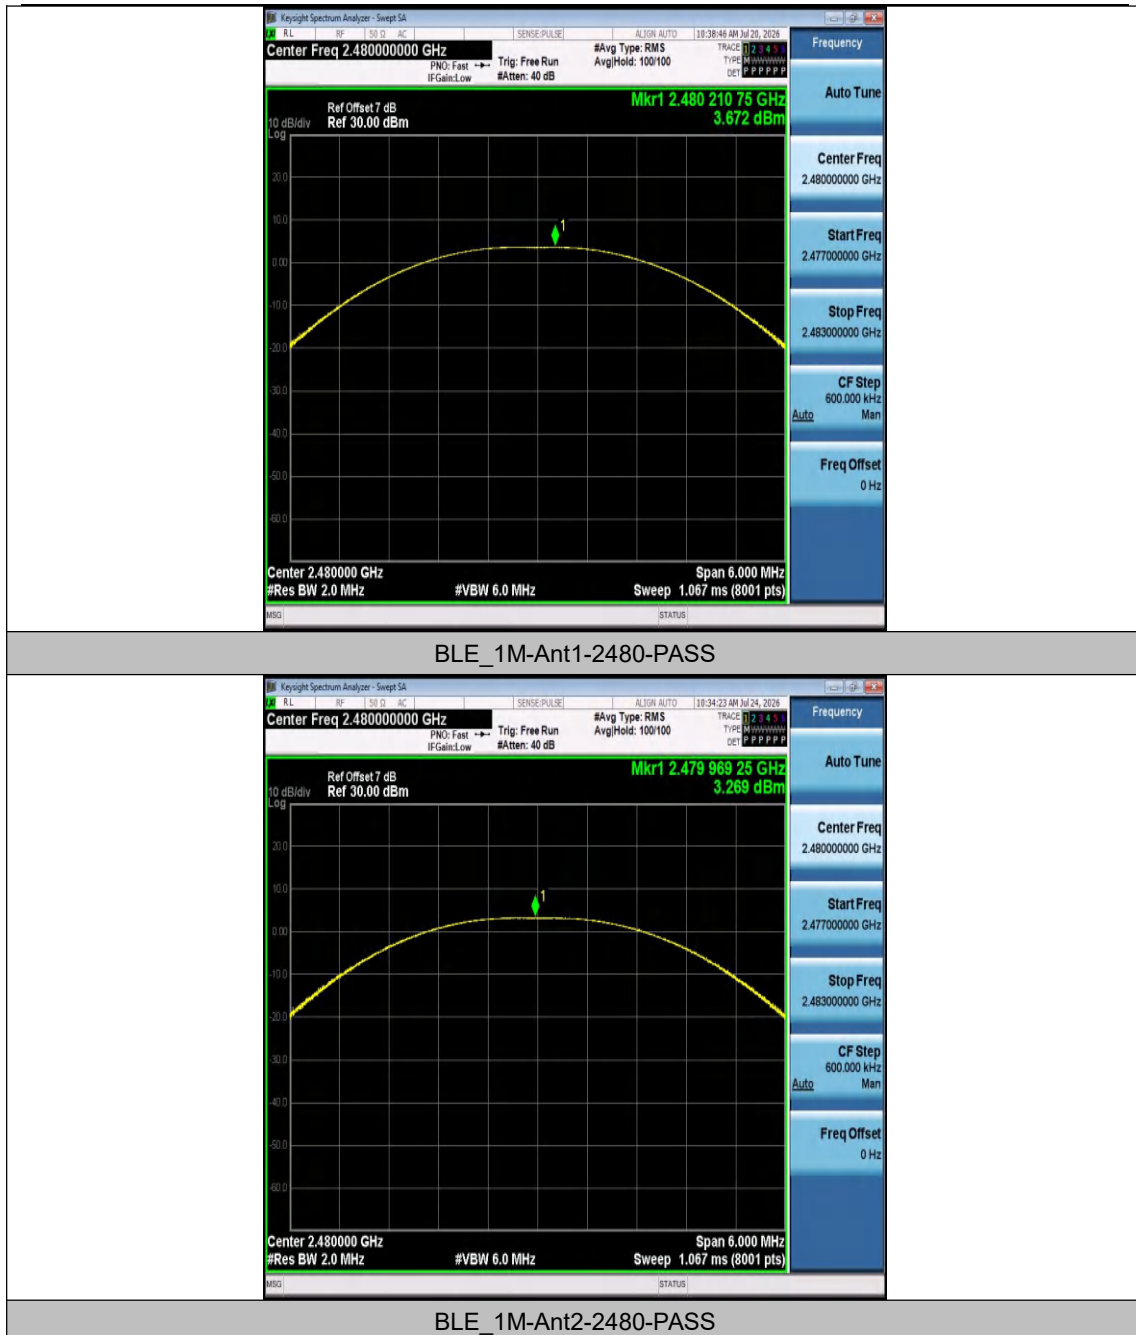

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

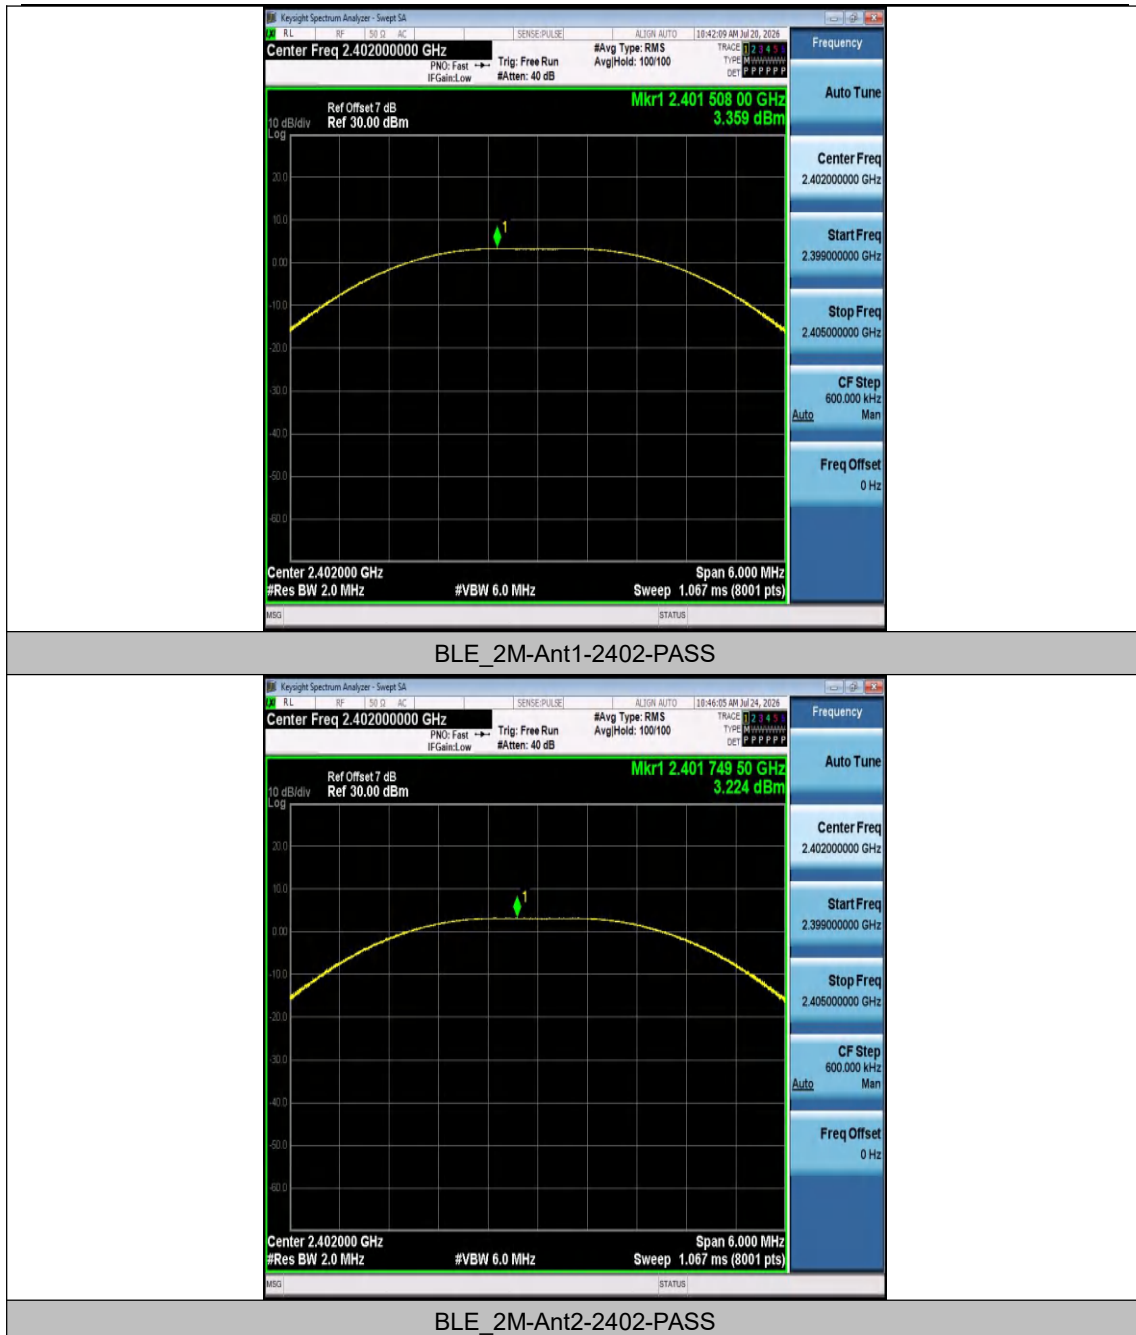

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

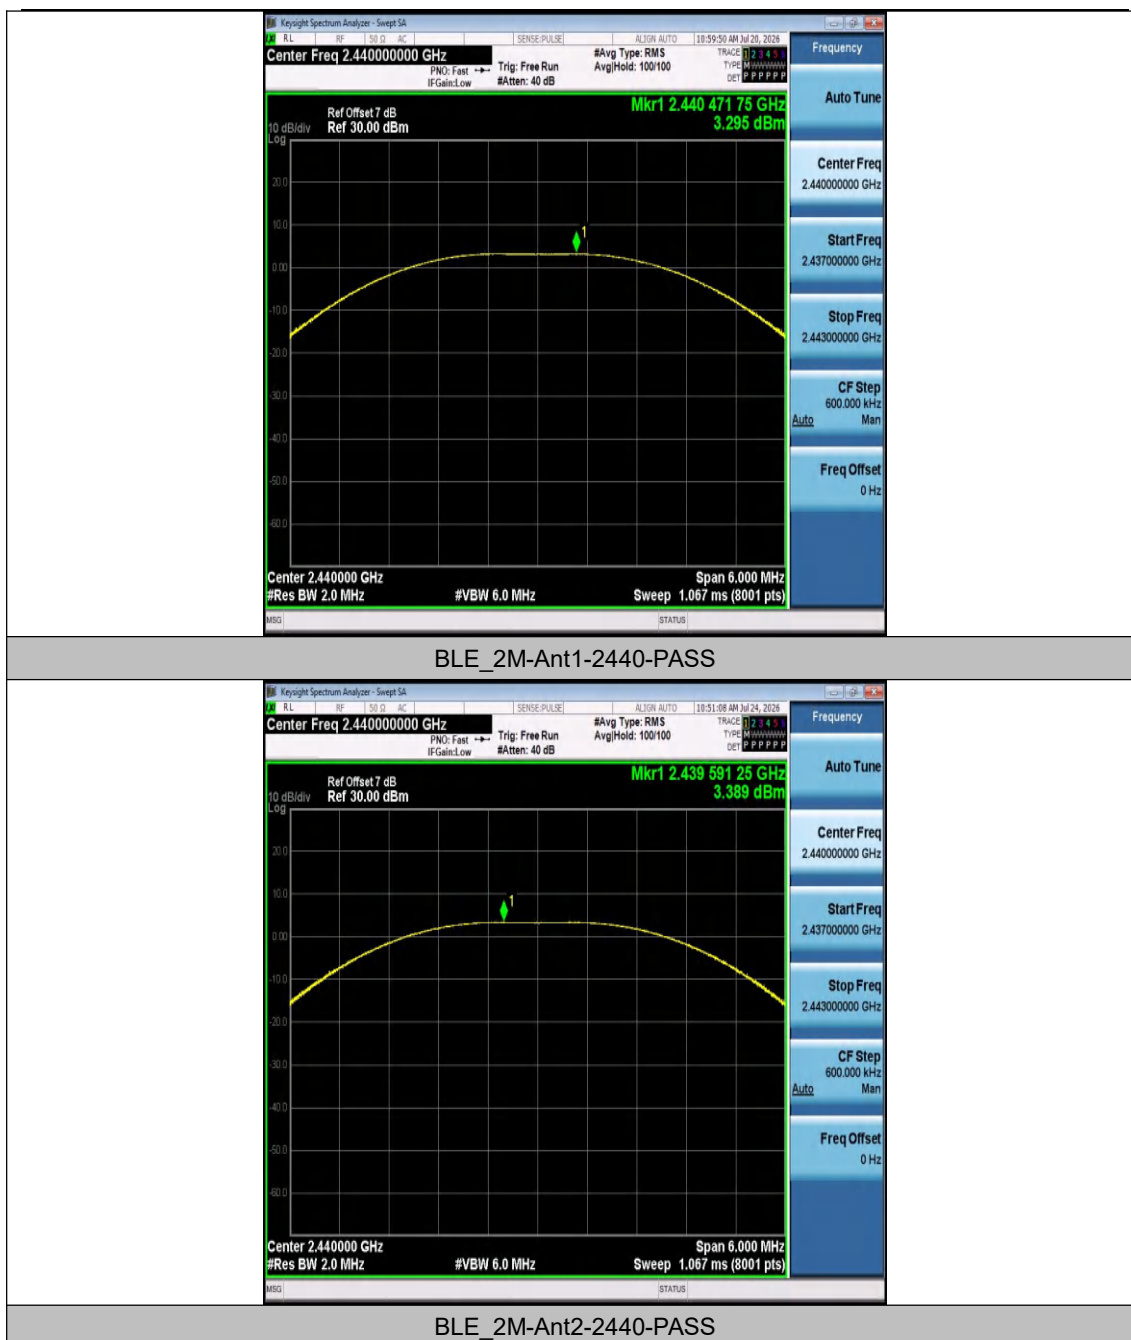

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

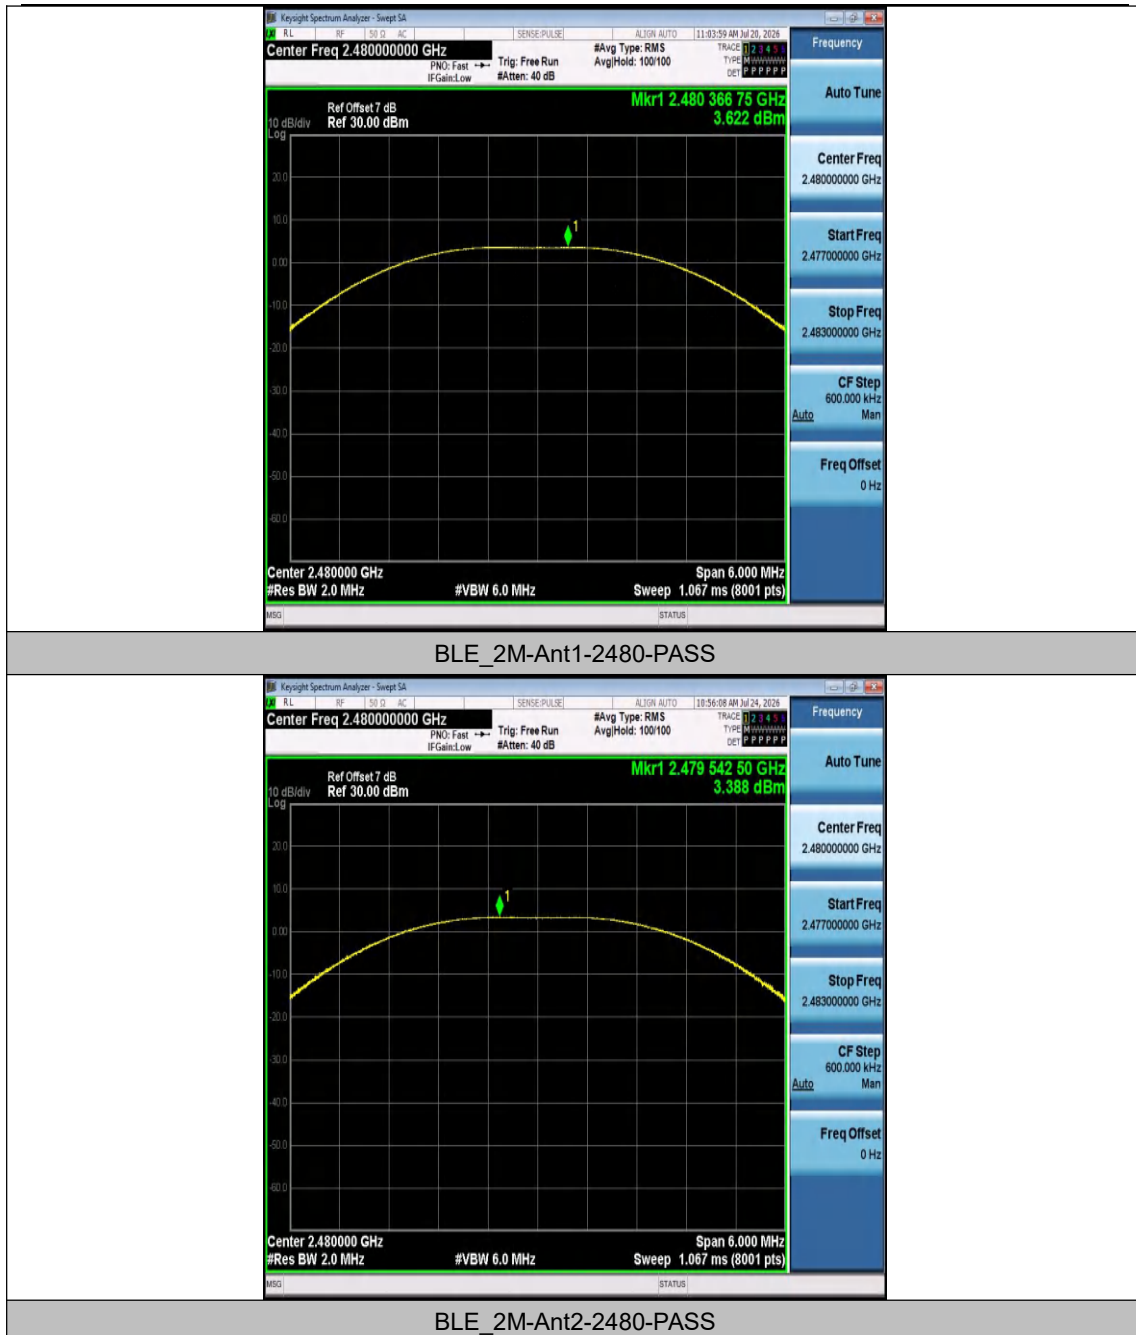

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum power spectral density

Test Result

TestMode	Antenna	Frequency[MHz]	Result[dBm/3kHz]	Limit[dBm/3kHz]	Verdict
BLE_1M	Ant2	2402	-12.07	≤8.00	PASS
BLE_1M	Ant1	2402	-12.14	≤8.00	PASS
BLE_1M	Ant1	2440	-12.05	≤8.00	PASS
BLE_1M	Ant2	2440	-12.02	≤8.00	PASS
BLE_1M	Ant1	2480	-12.21	≤8.00	PASS
BLE_1M	Ant2	2480	-12.21	≤8.00	PASS
BLE_2M	Ant1	2402	-14.05	≤8.00	PASS
BLE_2M	Ant2	2402	-14.05	≤8.00	PASS
BLE_2M	Ant1	2440	-13.79	≤8.00	PASS
BLE_2M	Ant2	2440	-14.09	≤8.00	PASS
BLE_2M	Ant1	2480	-14.14	≤8.00	PASS
BLE_2M	Ant2	2480	-14.00	≤8.00	PASS


Test Graphs

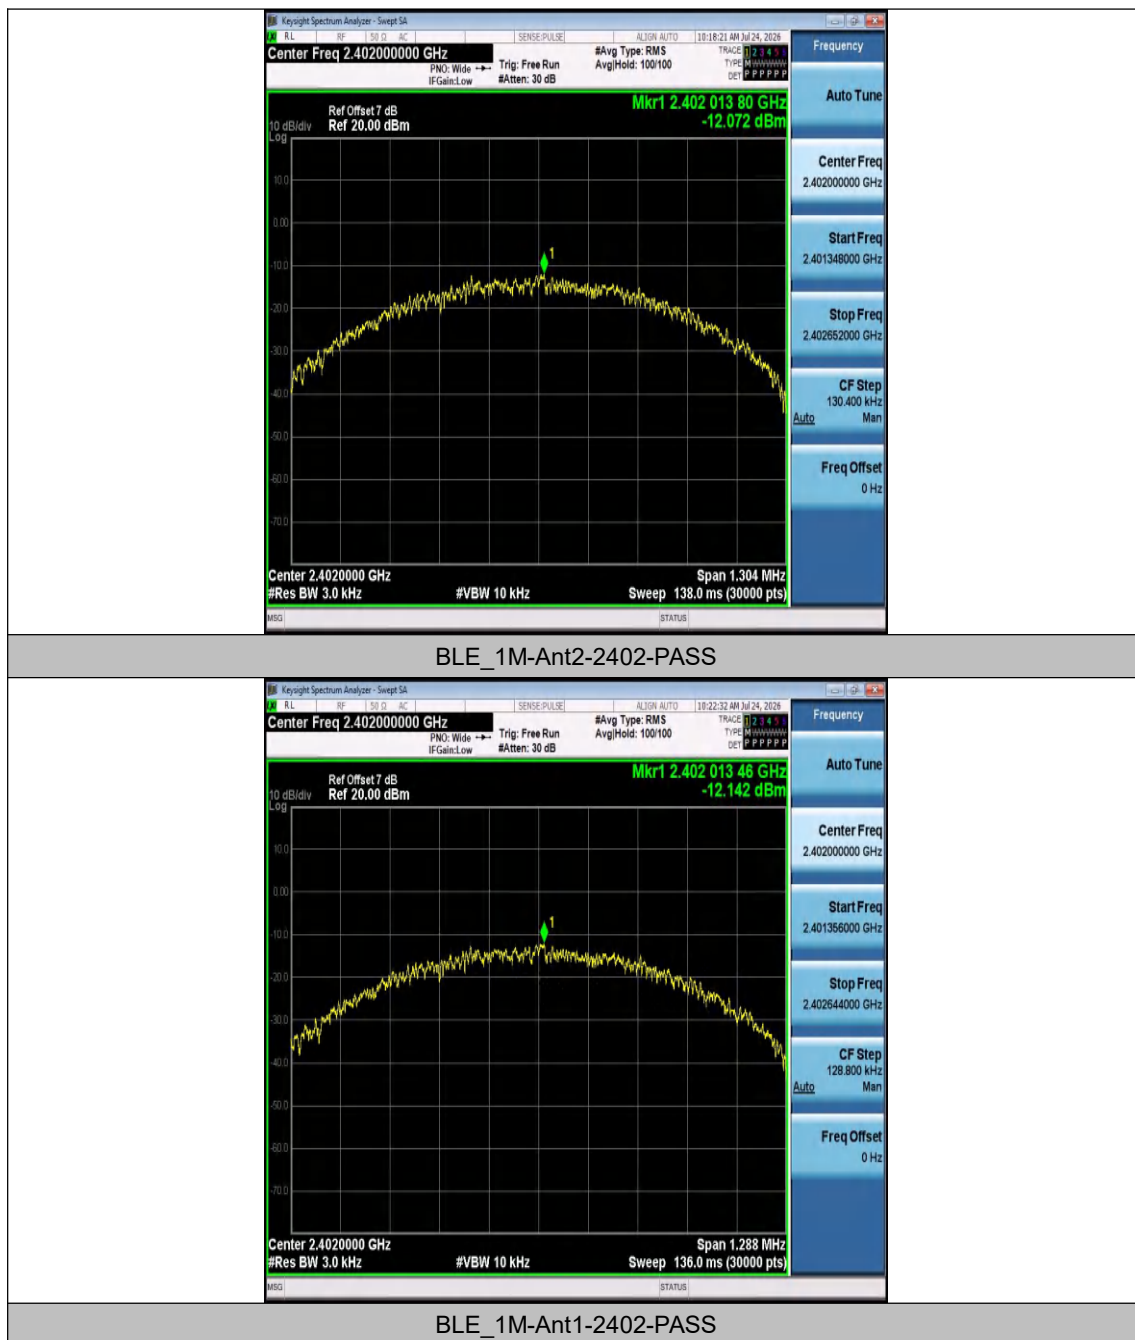

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

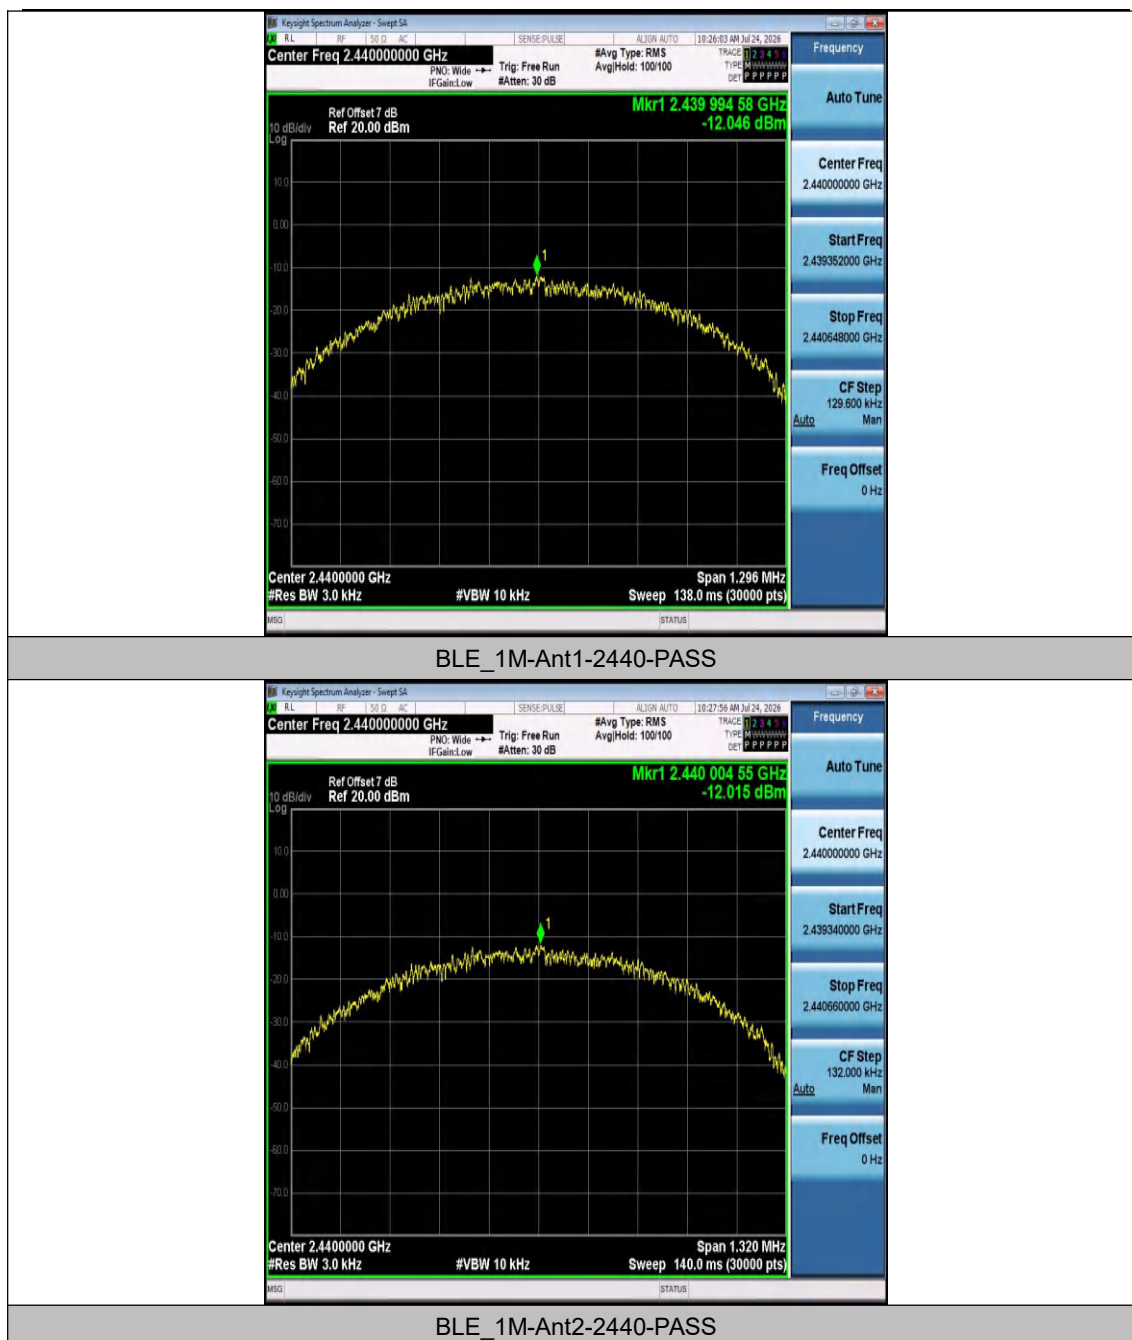

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

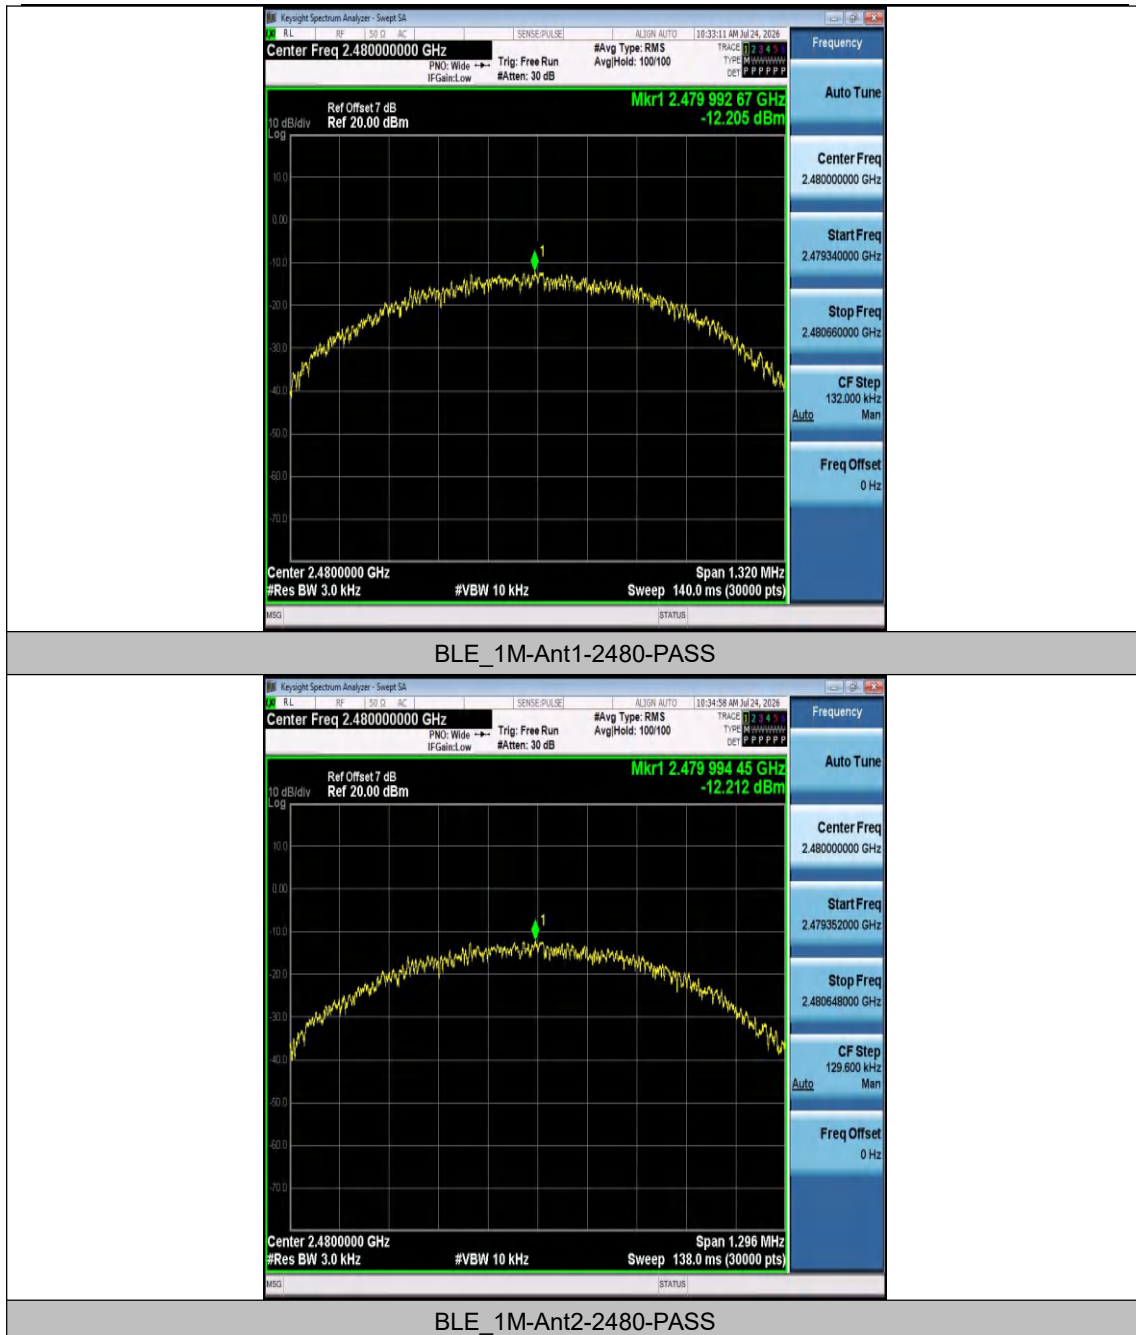

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

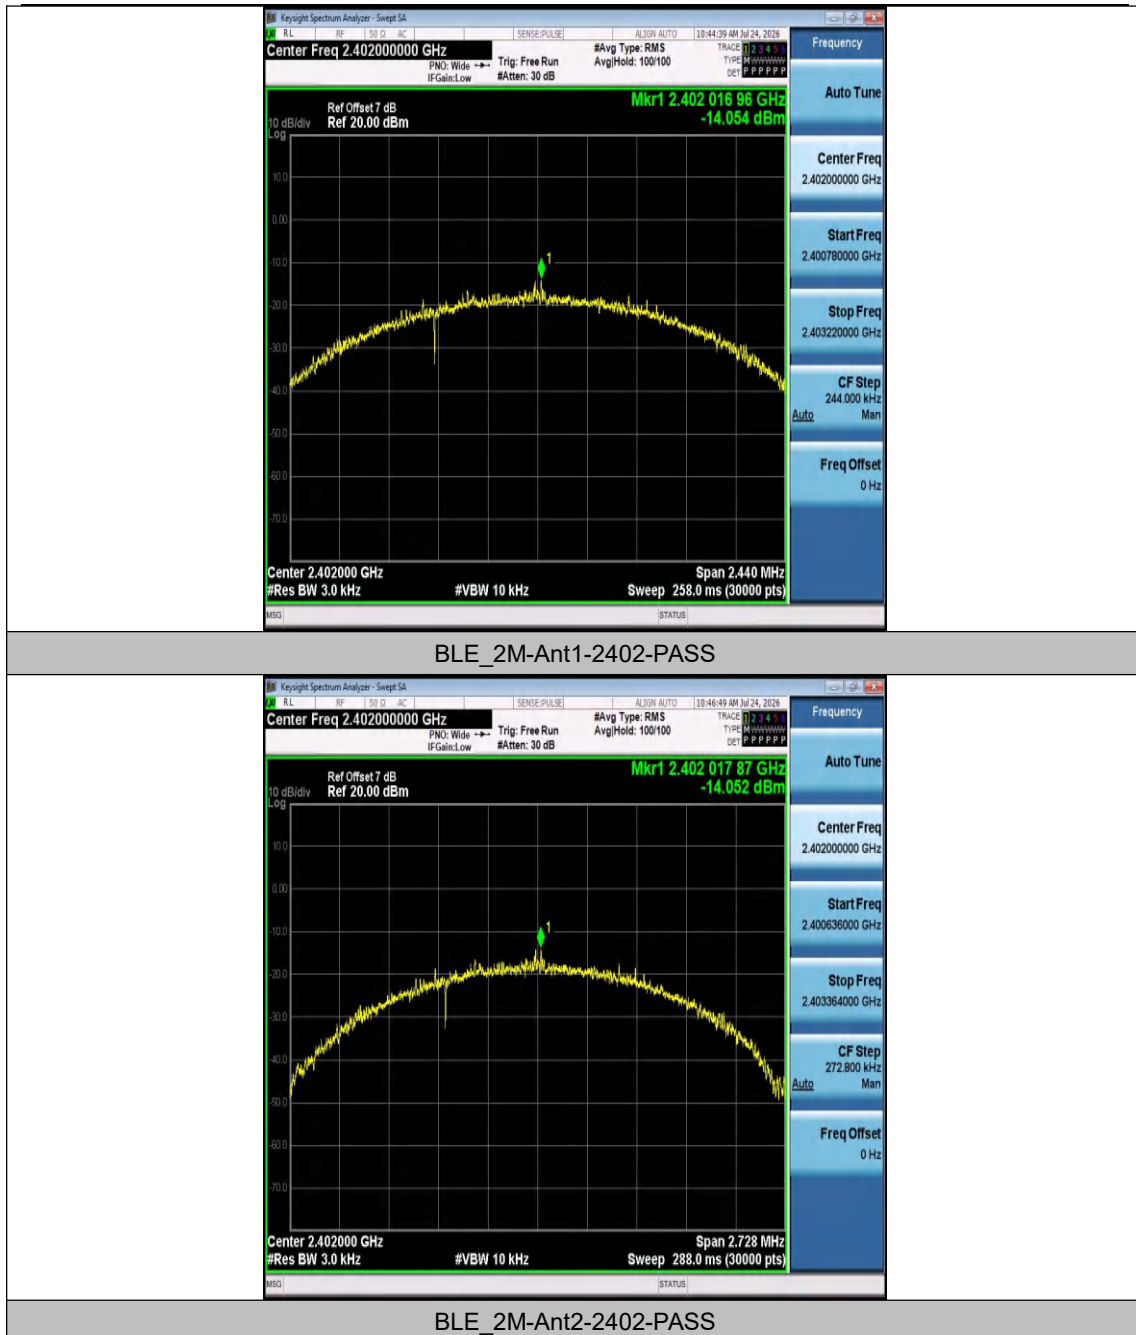

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

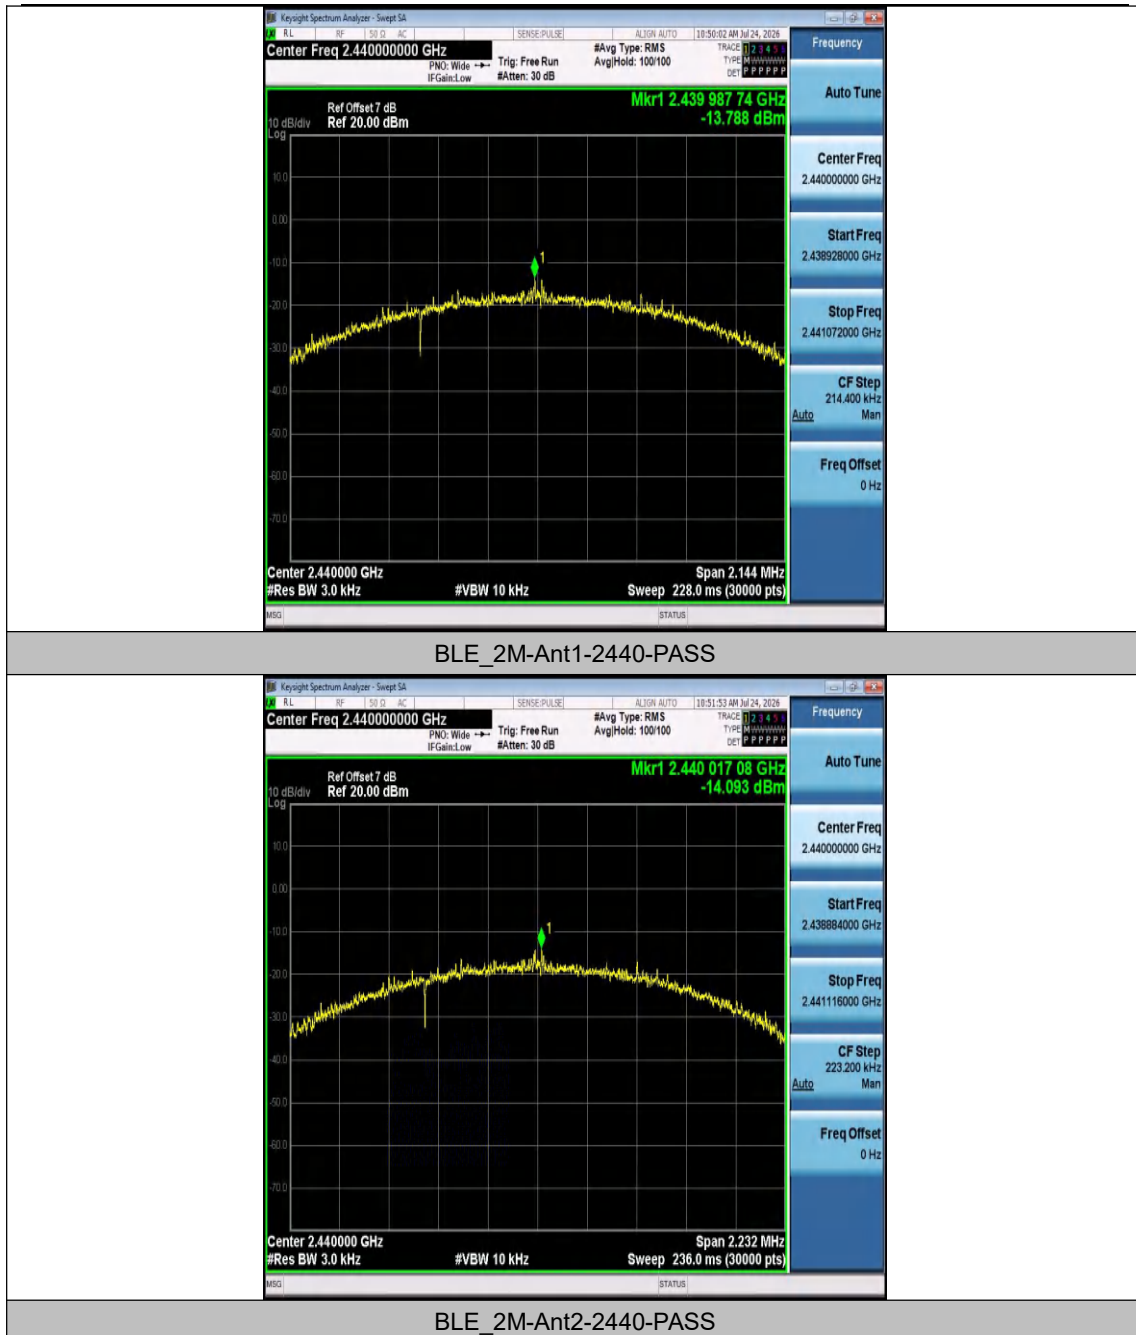

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

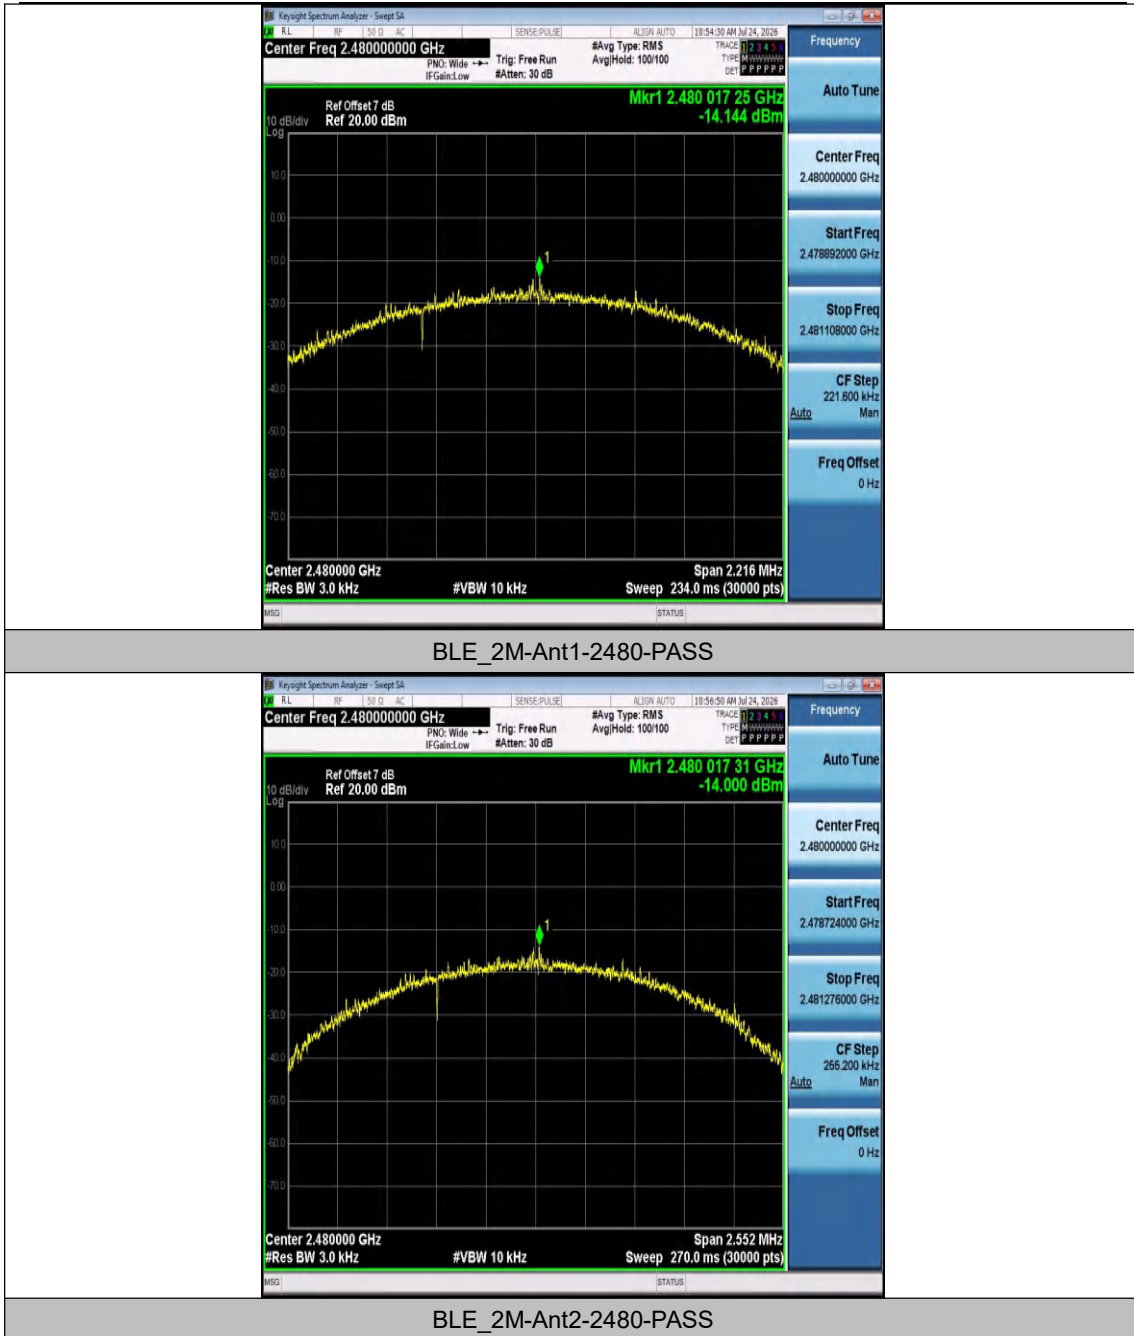

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix E: Band edge measurements


Test Result

Test Mode	Antenna	ChName	Frequency [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
BLE_1M	Ant1	Low	2402	2.99	-44.13	≤-17.01	PASS
BLE_1M	Ant2	Low	2402	2.54	-41.89	≤-17.46	PASS
BLE_1M	Ant1	High	2480	3.56	-42.44	≤-16.44	PASS
BLE_1M	Ant2	High	2480	2.68	-46.24	≤-17.32	PASS
BLE_2M	Ant1	Low	2402	3.35	-28.62	≤-16.65	PASS
BLE_2M	Ant2	Low	2402	2.99	-30.55	≤-17.01	PASS
BLE_2M	Ant1	High	2480	3.69	-42.95	≤-16.31	PASS
BLE_2M	Ant2	High	2480	2.96	-46.66	≤-17.04	PASS

Test Graphs

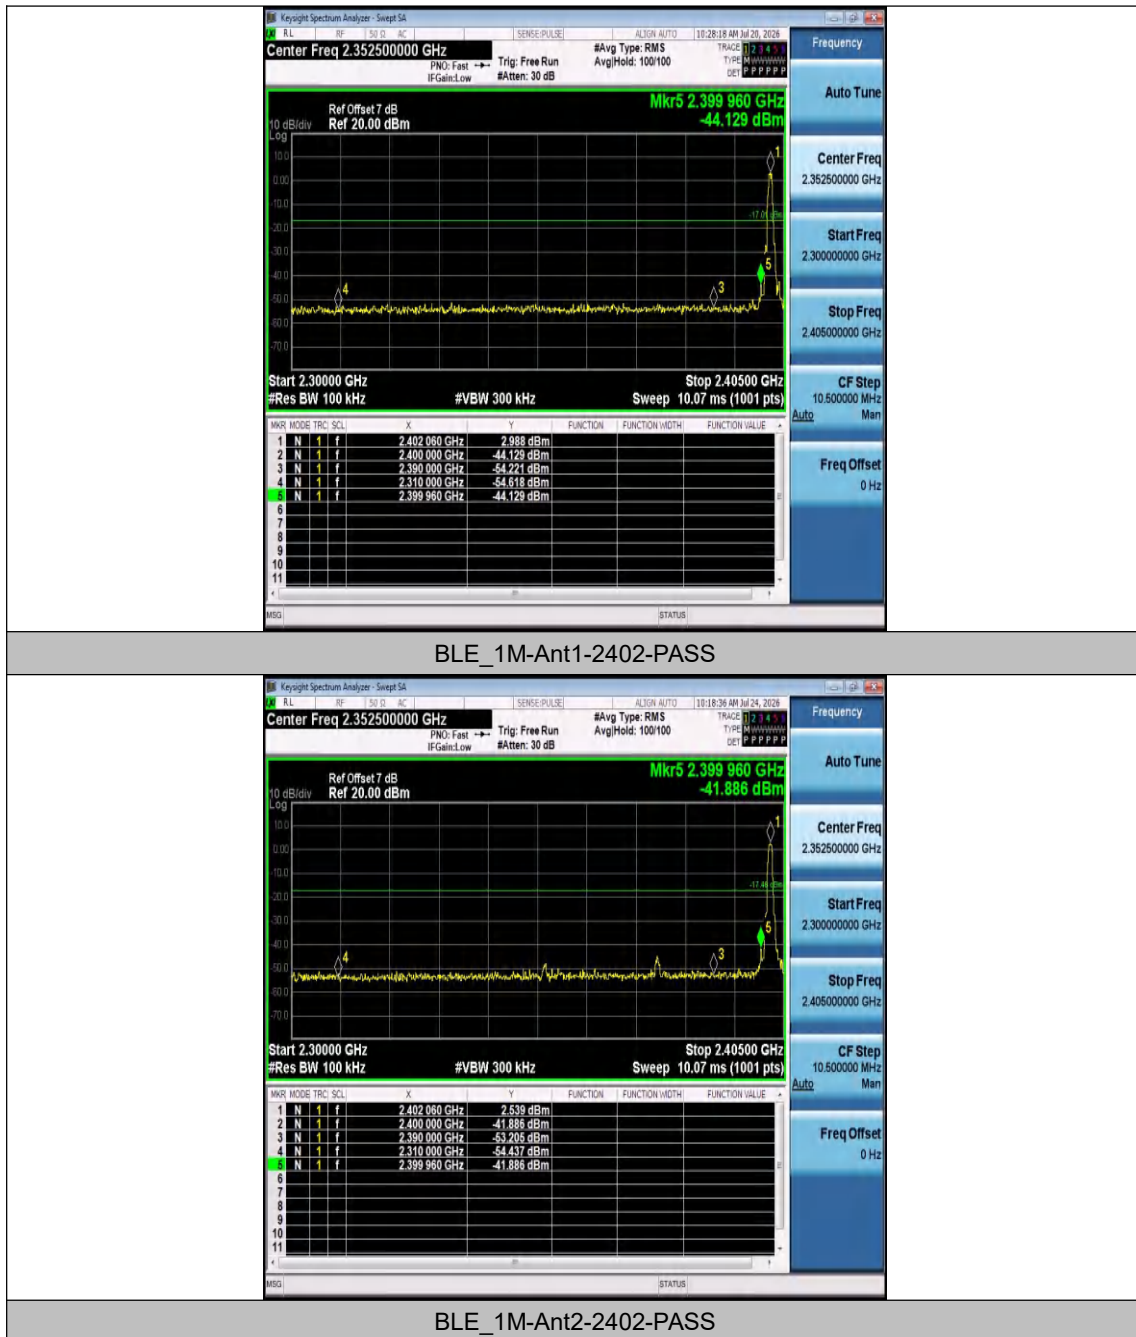

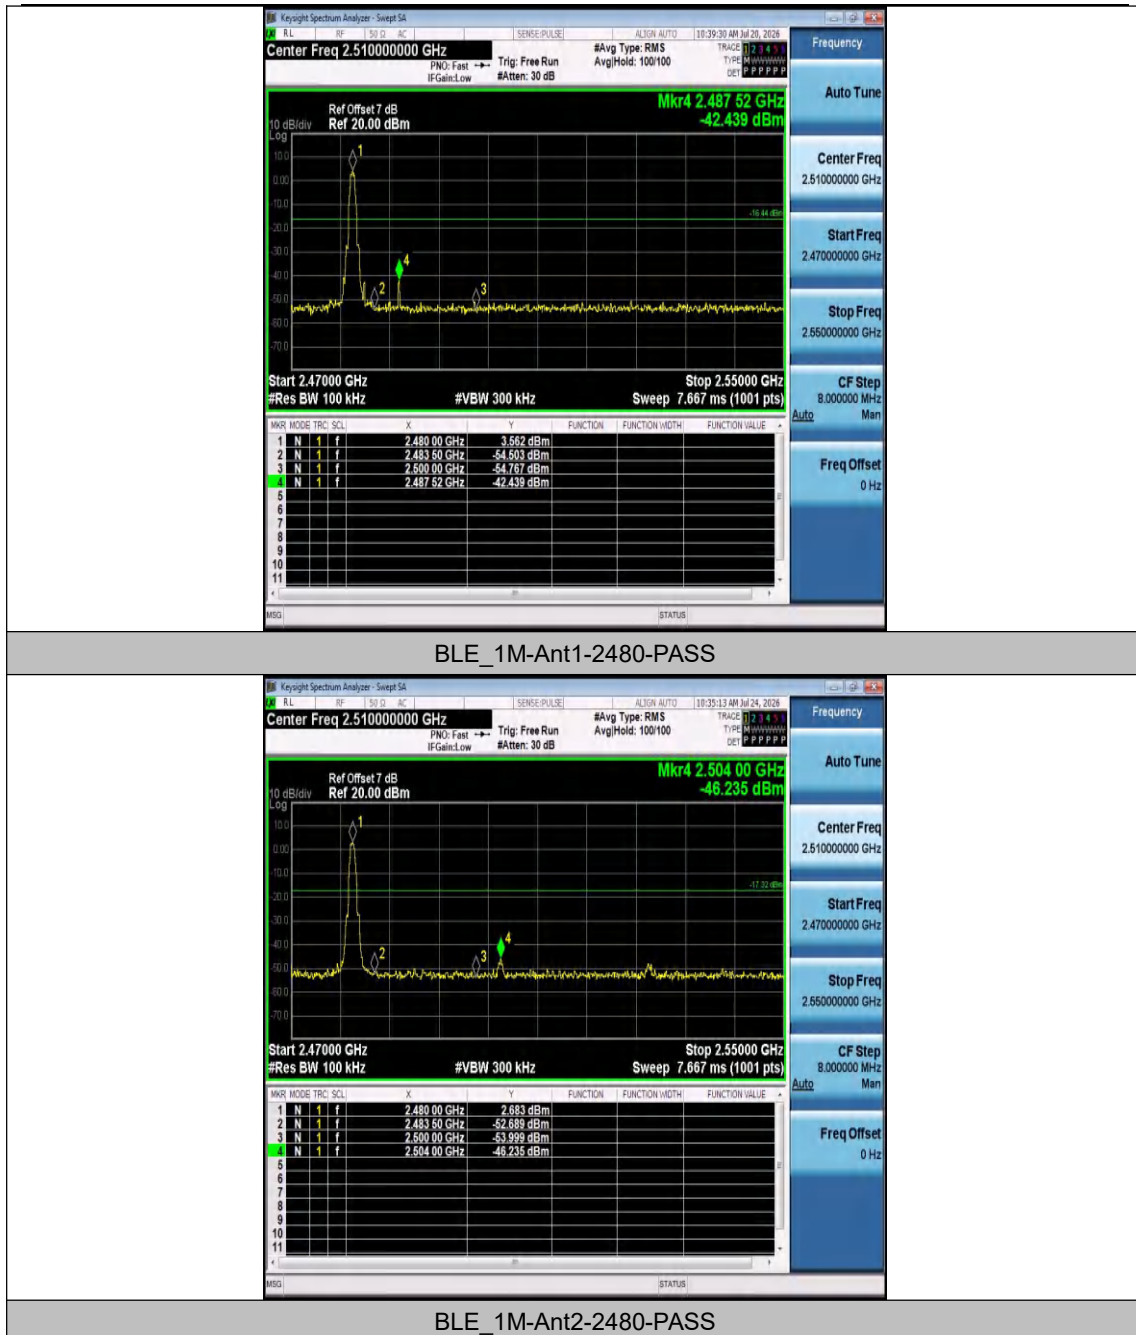


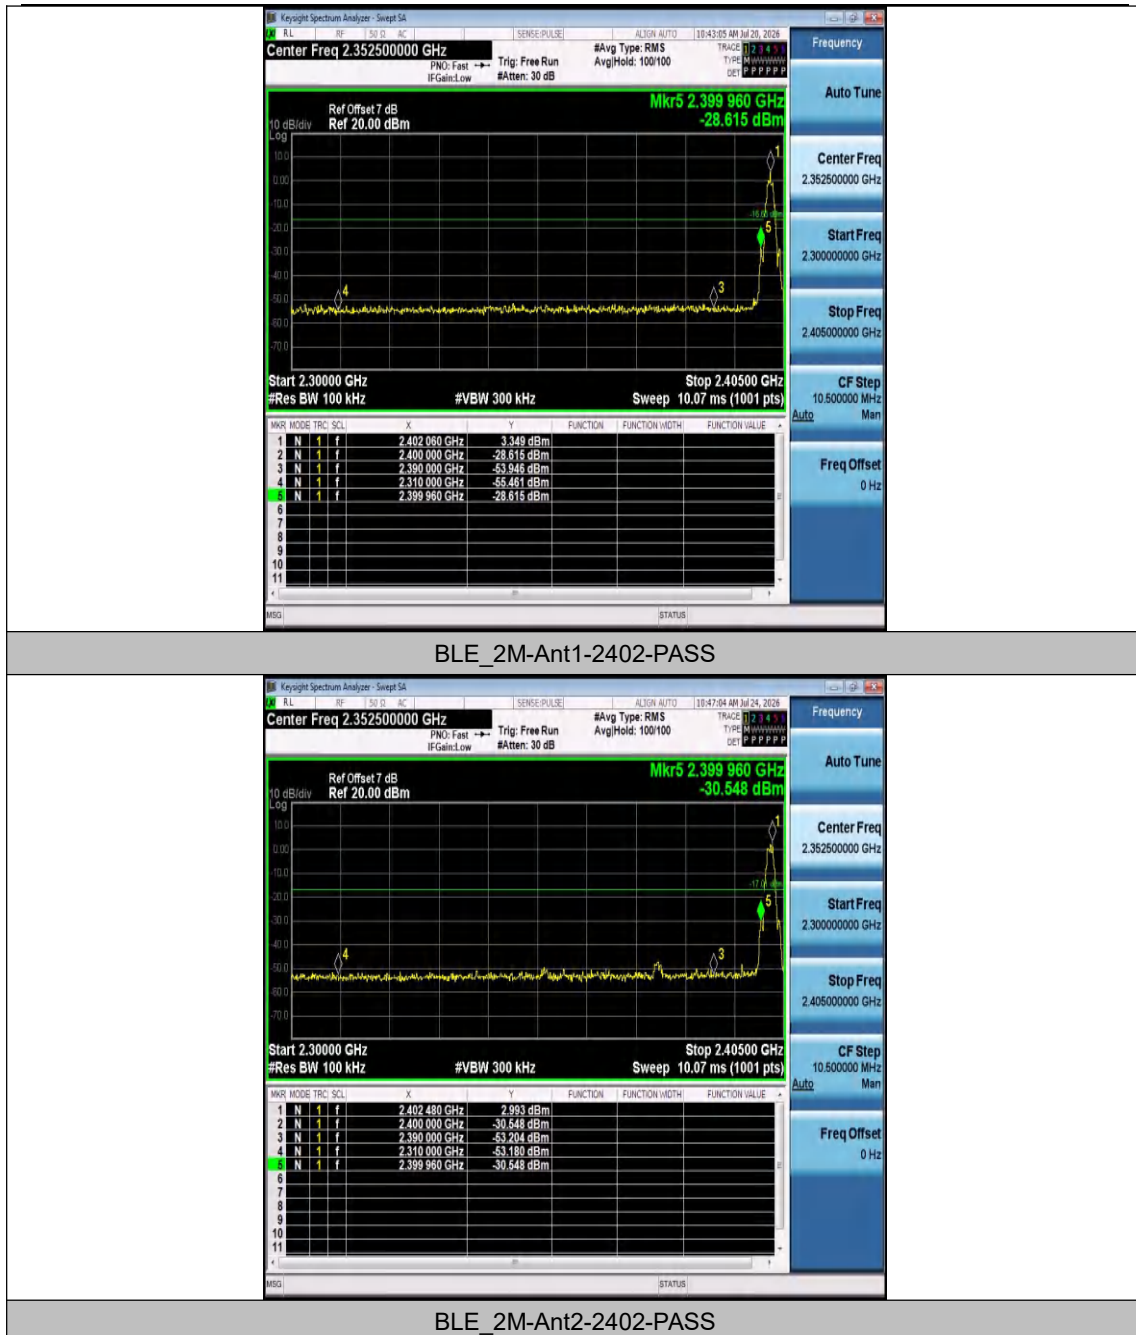

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

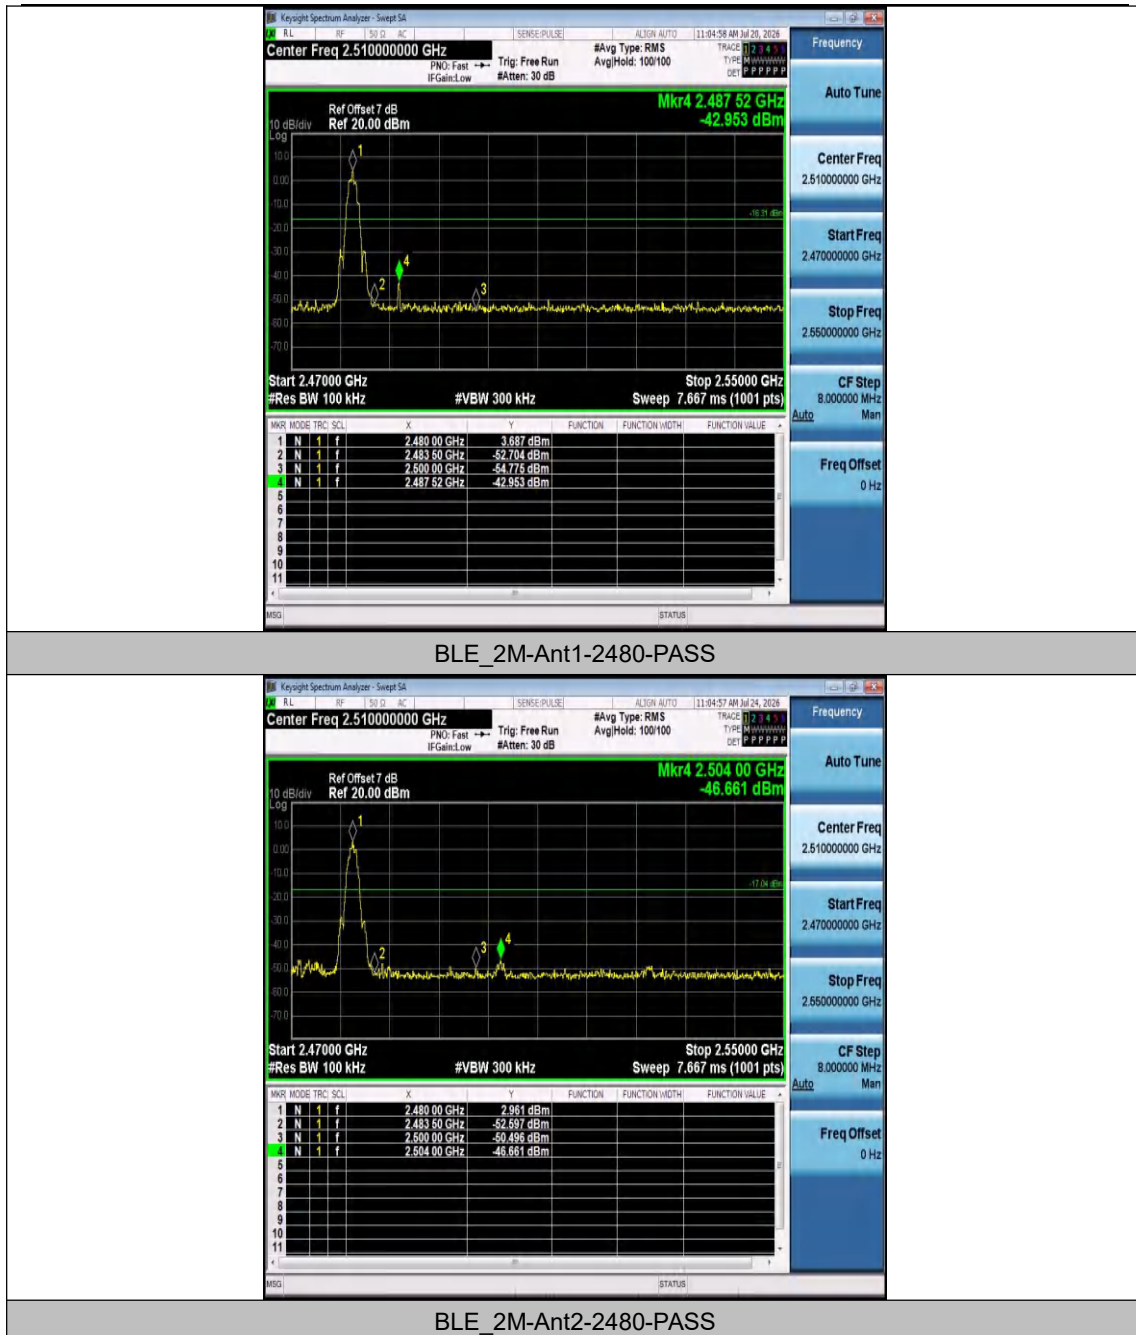

Appendix F: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
BLE_1M	Ant1	2402	0~Reference	3.18	3.18	---	PASS
BLE_1M	Ant2	2402	0~Reference	2.84	2.84	---	PASS
BLE_1M	Ant1	2402	30~1000	3.18	-52.45	≤-16.82	PASS
BLE_1M	Ant2	2402	30~1000	2.84	-51.55	≤-17.16	PASS
BLE_1M	Ant1	2402	1000~26500	3.18	-37.41	≤-16.82	PASS
BLE_1M	Ant2	2402	1000~26500	2.84	-36.45	≤-17.16	PASS
BLE_1M	Ant1	2440	0~Reference	3.12	3.12	---	PASS
BLE_1M	Ant2	2440	0~Reference	2.69	2.69	---	PASS
BLE_1M	Ant1	2440	30~1000	3.12	-52.22	≤-16.88	PASS
BLE_1M	Ant2	2440	30~1000	2.69	-51.29	≤-17.31	PASS
BLE_1M	Ant1	2440	1000~26500	3.12	-36.93	≤-16.88	PASS
BLE_1M	Ant2	2440	1000~26500	2.69	-36.28	≤-17.31	PASS
BLE_1M	Ant1	2480	0~Reference	3.09	3.09	---	PASS
BLE_1M	Ant2	2480	0~Reference	2.91	2.91	---	PASS
BLE_1M	Ant1	2480	30~1000	3.09	-52.05	≤-16.91	PASS
BLE_1M	Ant2	2480	30~1000	2.91	-51.09	≤-17.09	PASS
BLE_1M	Ant1	2480	1000~26500	3.09	-36.53	≤-16.91	PASS
BLE_1M	Ant2	2480	1000~26500	2.91	-36.12	≤-17.09	PASS
BLE_2M	Ant1	2402	0~Reference	2.97	2.97	---	PASS
BLE_2M	Ant2	2402	0~Reference	2.71	2.71	---	PASS
BLE_2M	Ant1	2402	30~1000	2.97	-52.22	≤-17.03	PASS
BLE_2M	Ant2	2402	30~1000	2.71	-50.97	≤-17.29	PASS
BLE_2M	Ant1	2402	1000~26500	2.97	-37.51	≤-17.03	PASS
BLE_2M	Ant2	2402	1000~26500	2.71	-36.69	≤-17.29	PASS
BLE_2M	Ant1	2440	0~Reference	3.14	3.14	---	PASS
BLE_2M	Ant2	2440	0~Reference	2.80	2.80	---	PASS
BLE_2M	Ant1	2440	30~1000	3.14	-51.88	≤-16.86	PASS
BLE_2M	Ant2	2440	30~1000	2.80	-51.89	≤-17.2	PASS
BLE_2M	Ant1	2440	1000~26500	3.14	-36.6	≤-16.86	PASS
BLE_2M	Ant2	2440	1000~26500	2.80	-36.31	≤-17.2	PASS
BLE_2M	Ant1	2480	0~Reference	3.46	3.46	---	PASS
BLE_2M	Ant2	2480	0~Reference	3.16	3.16	---	PASS
BLE_2M	Ant1	2480	30~1000	3.46	-52.27	≤-16.54	PASS
BLE_2M	Ant2	2480	30~1000	3.16	-42.47	≤-16.84	PASS
BLE_2M	Ant1	2480	1000~26500	3.46	-37.16	≤-16.54	PASS
BLE_2M	Ant2	2480	1000~26500	3.16	-35.19	≤-16.84	PASS


Remark: Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'Input Correction' of the Spectrum Analyzer during the test.

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

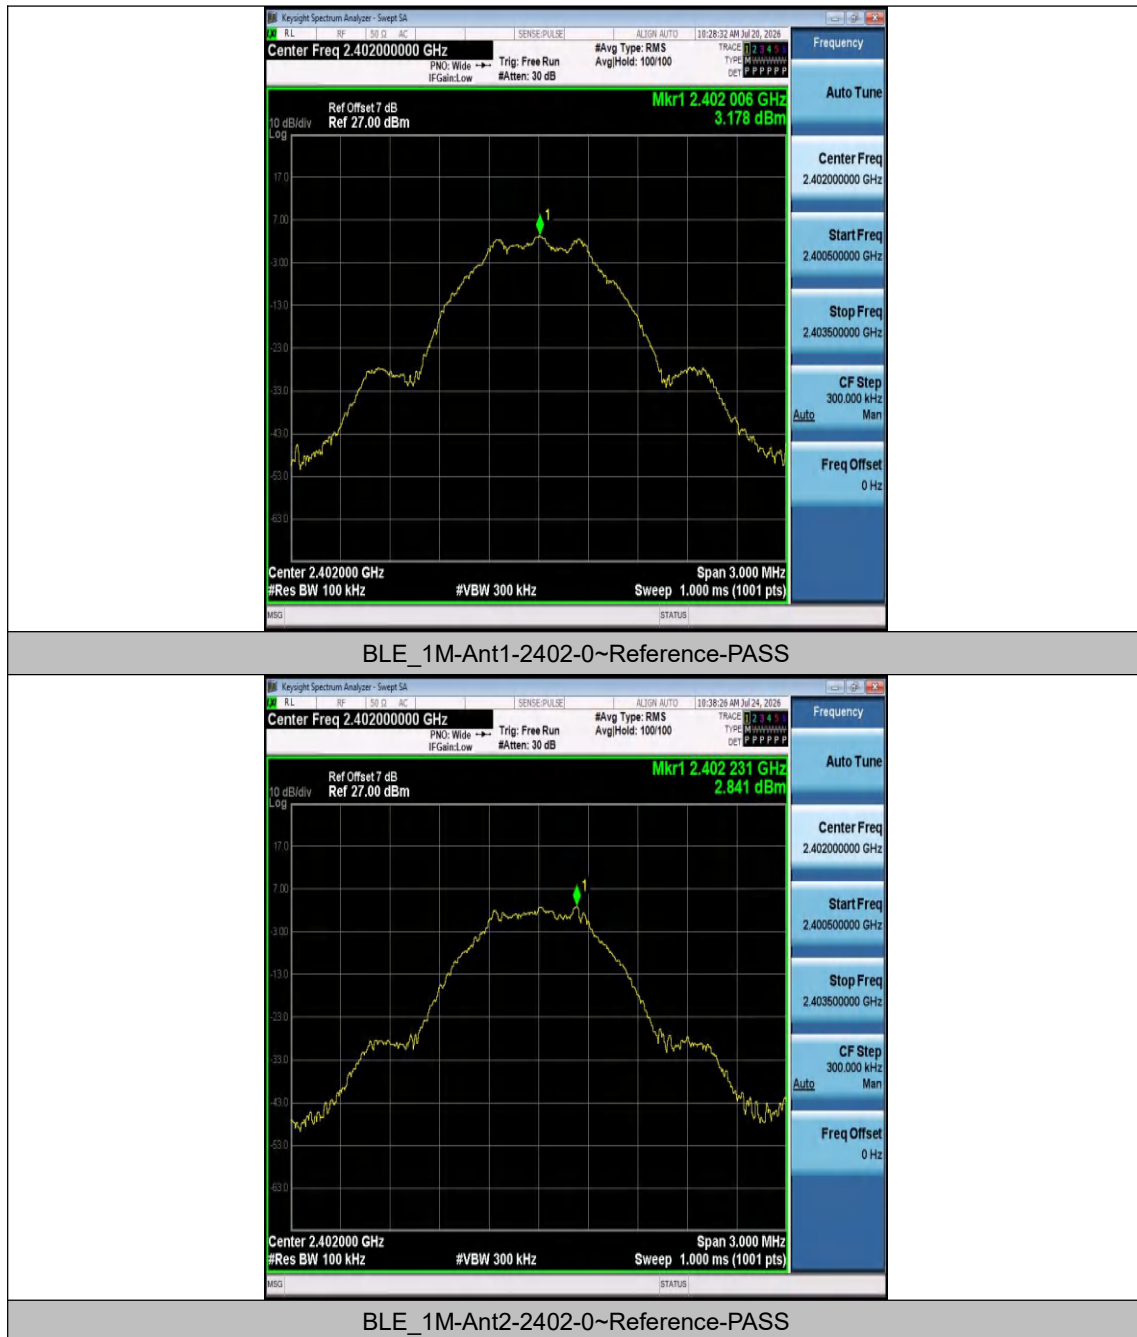

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

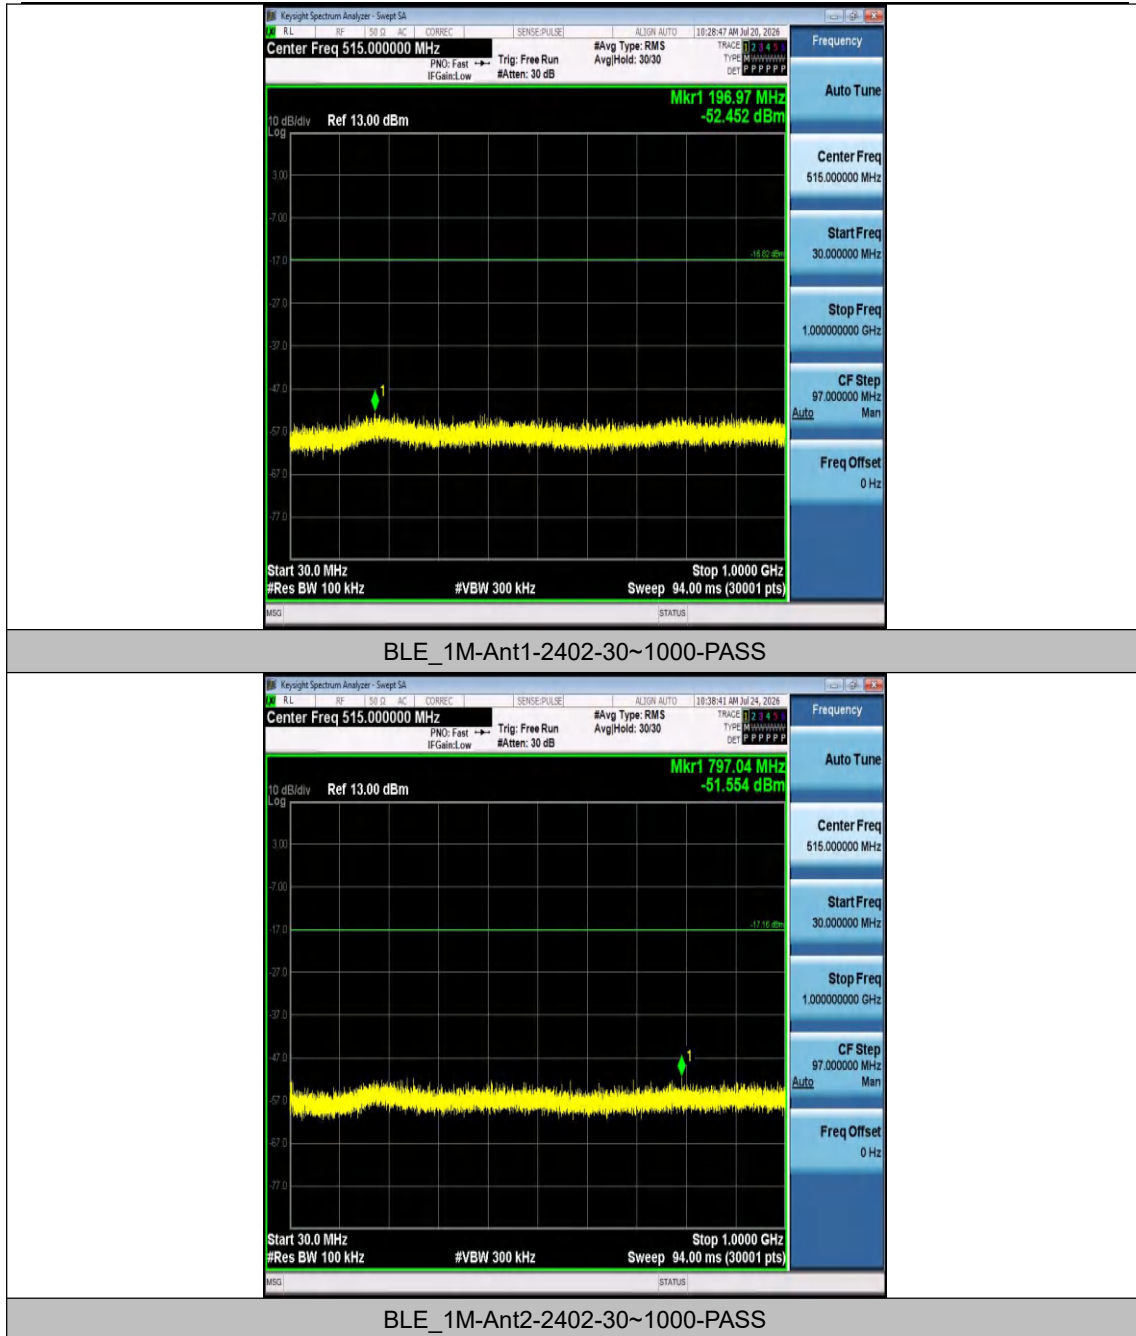

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

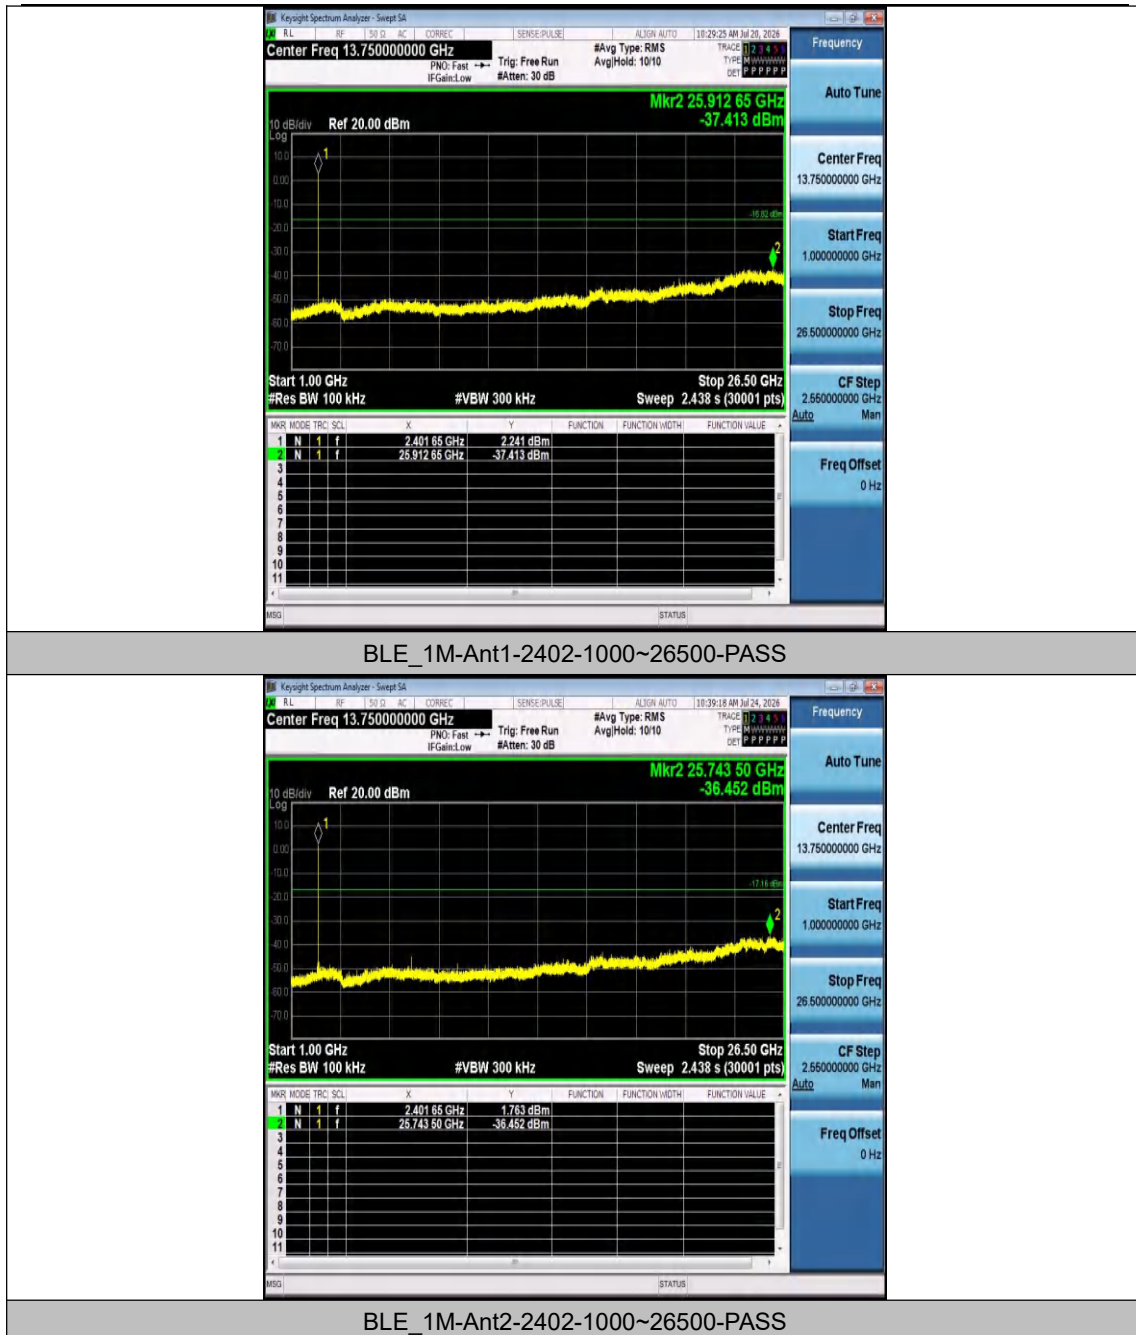

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

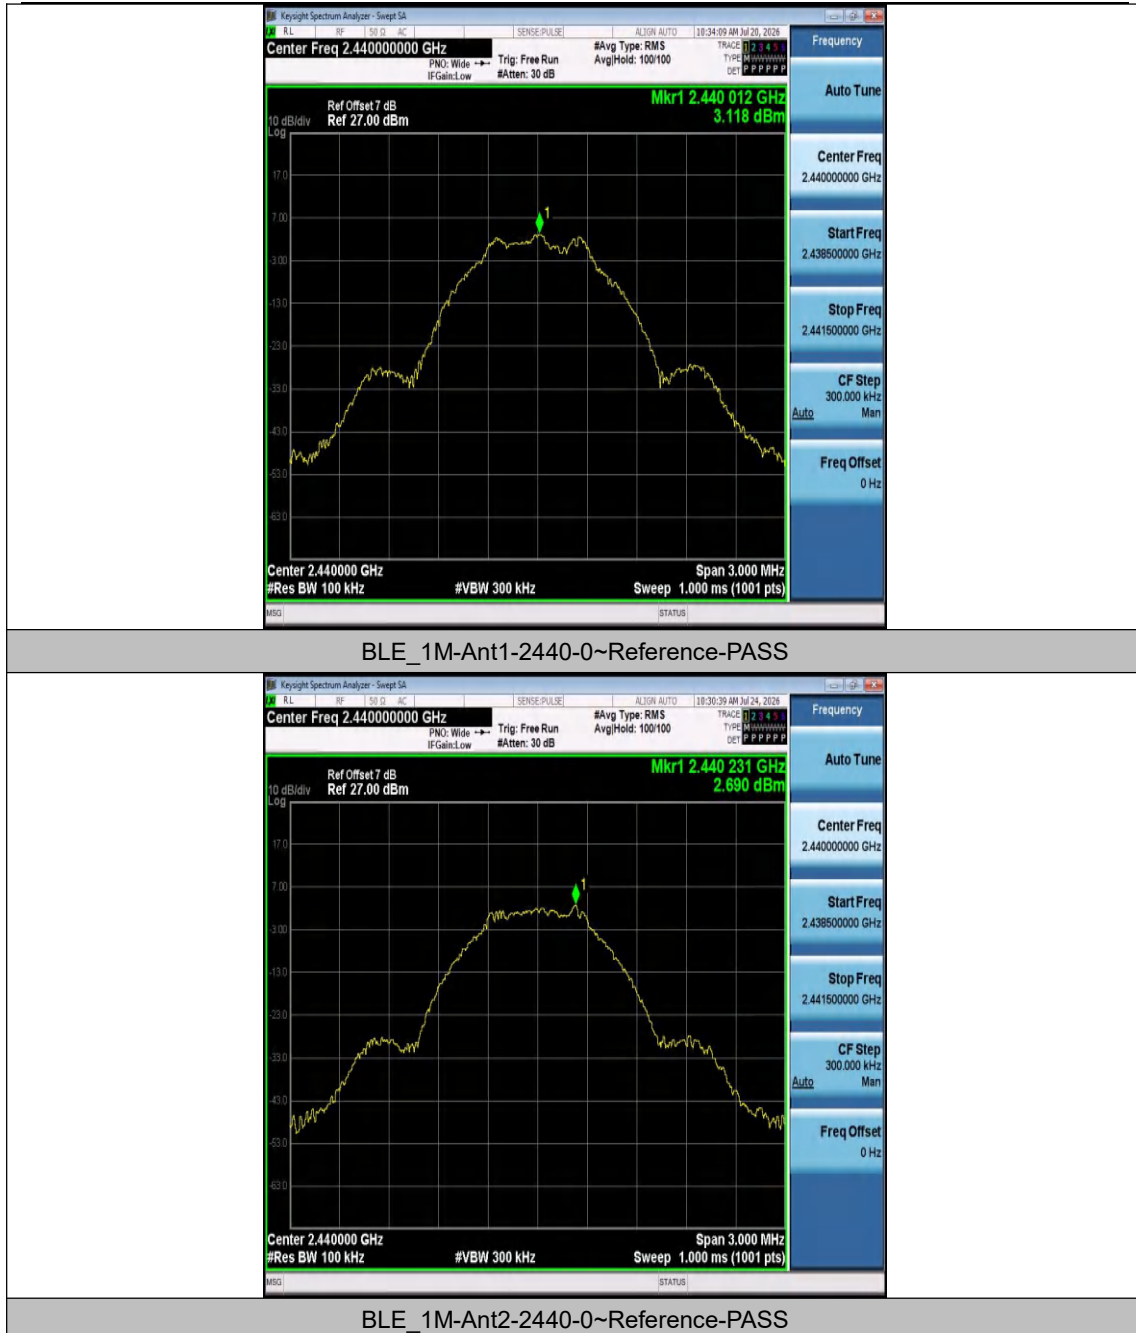

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

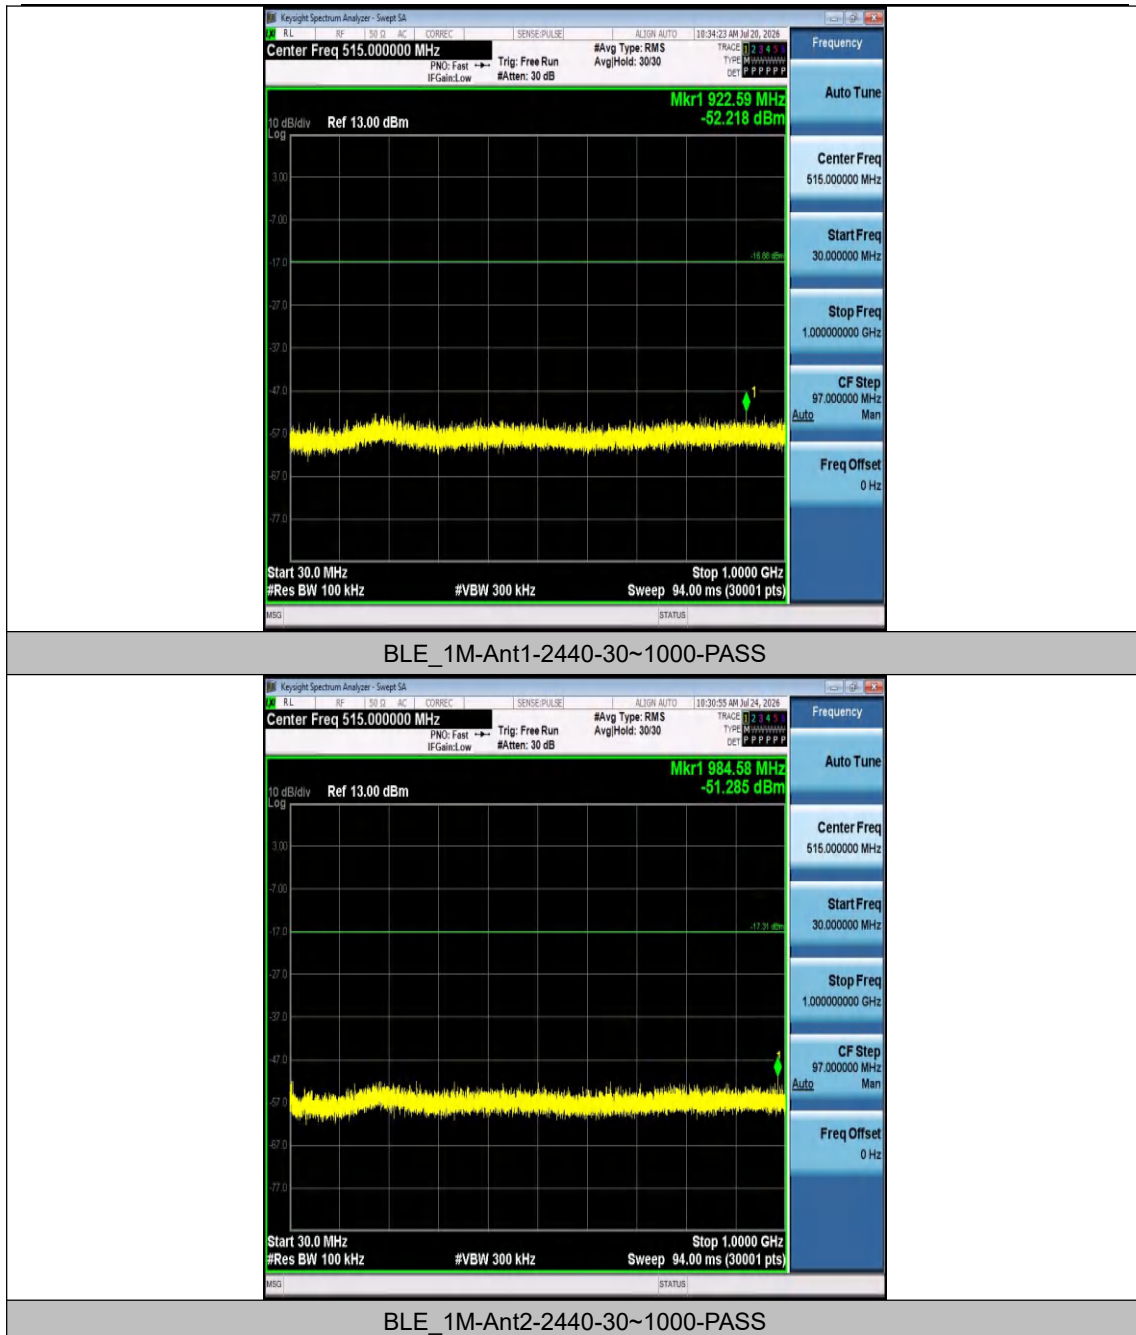

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

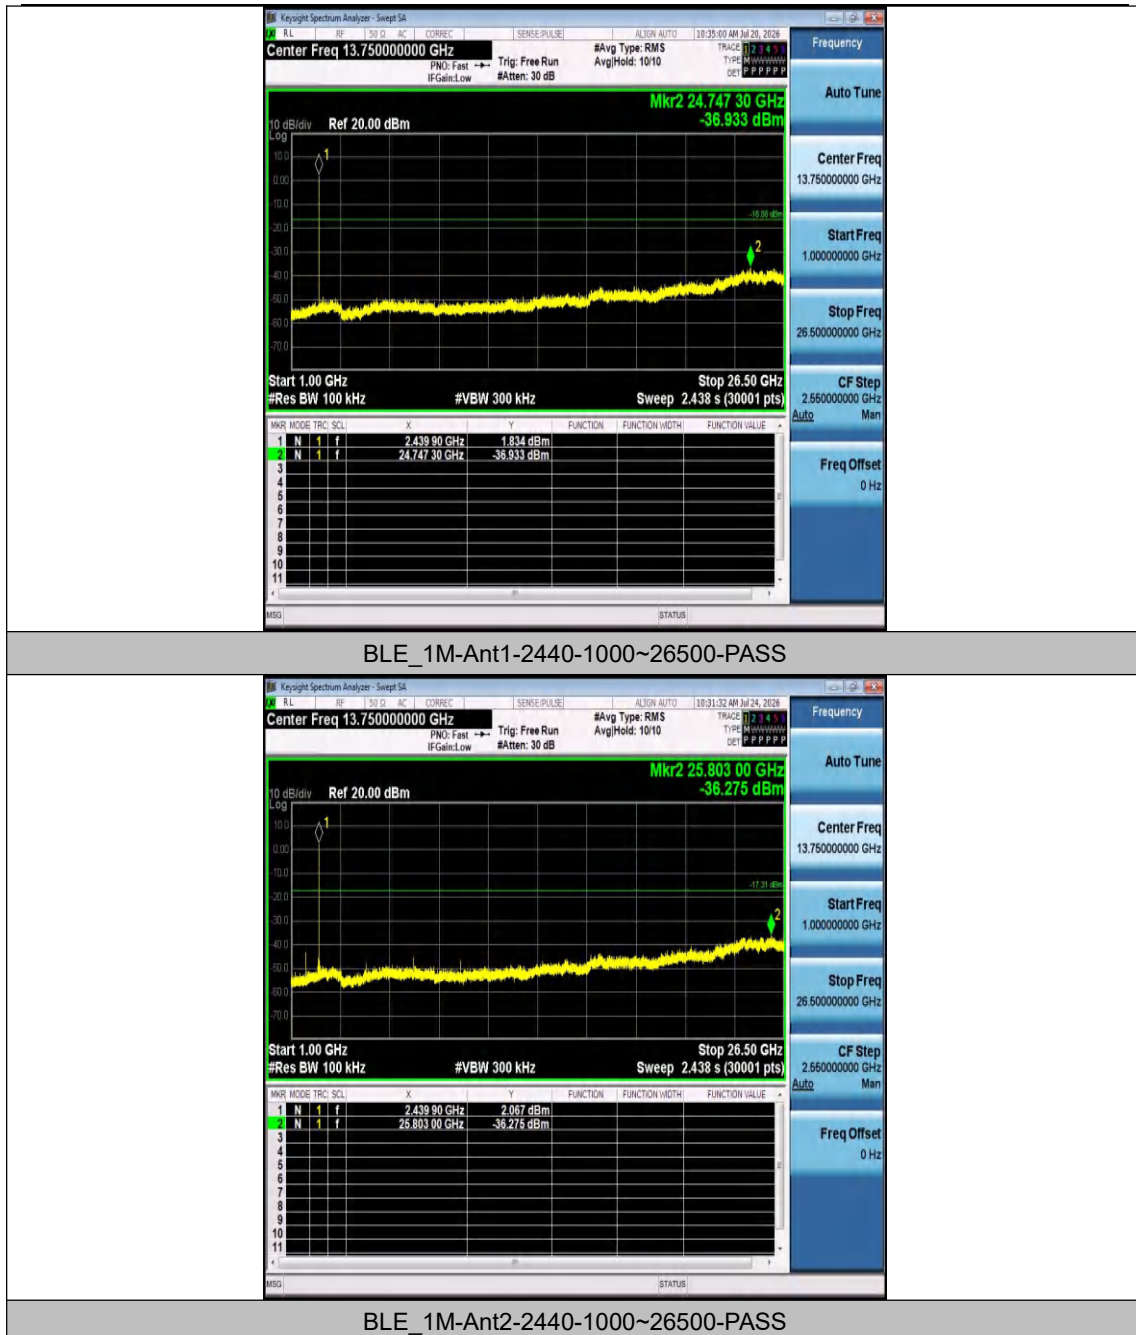

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

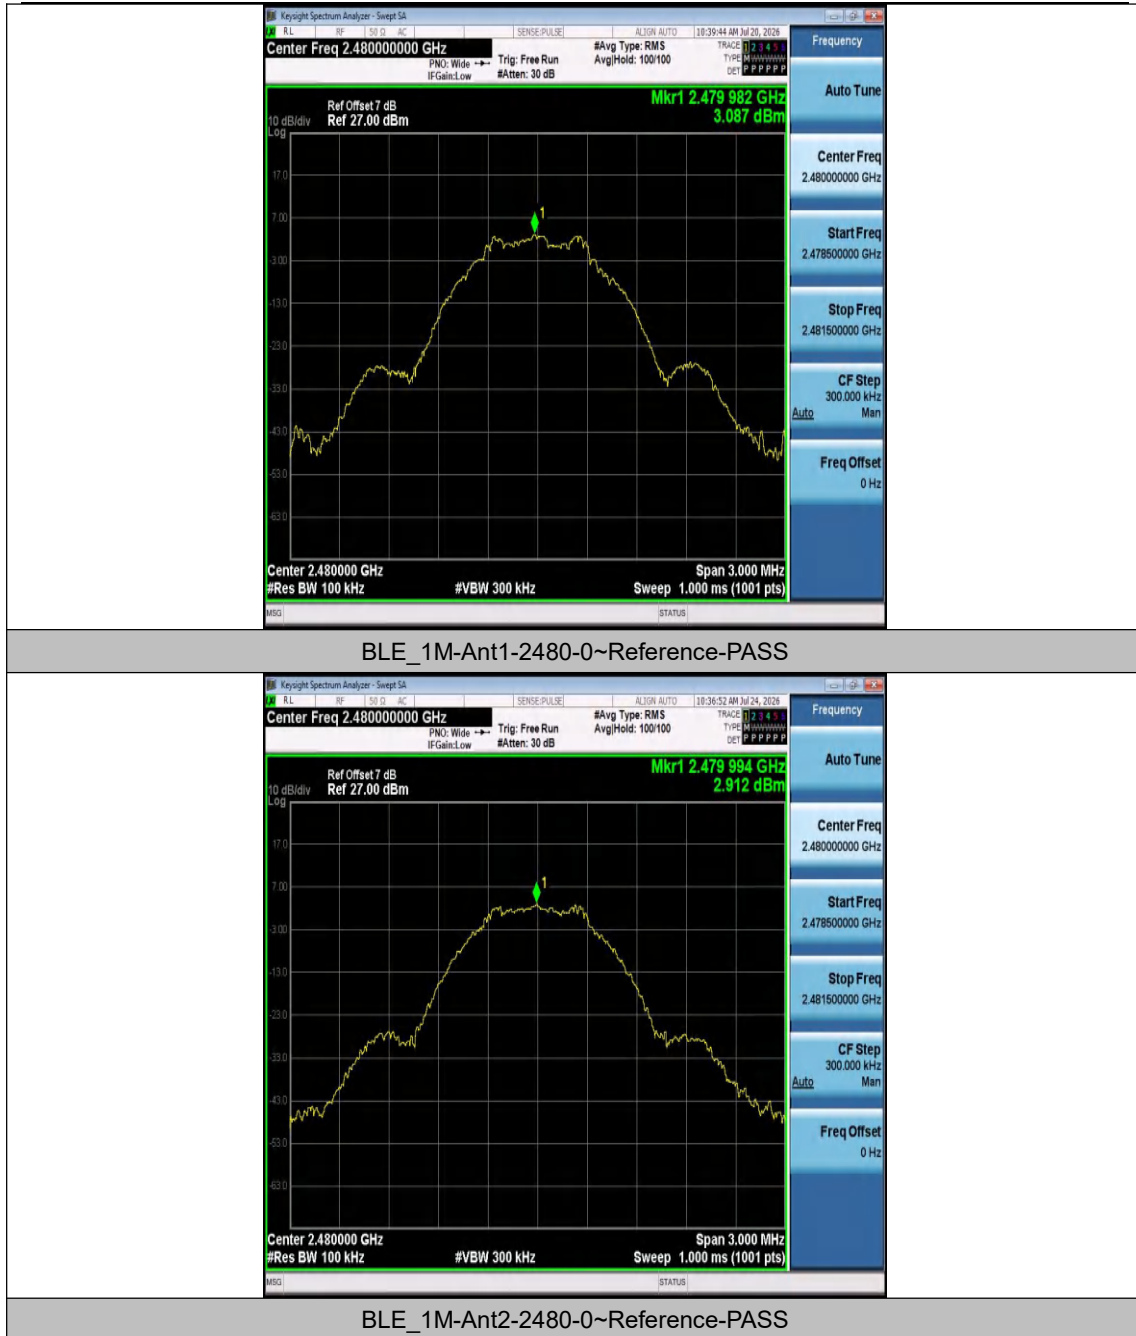

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

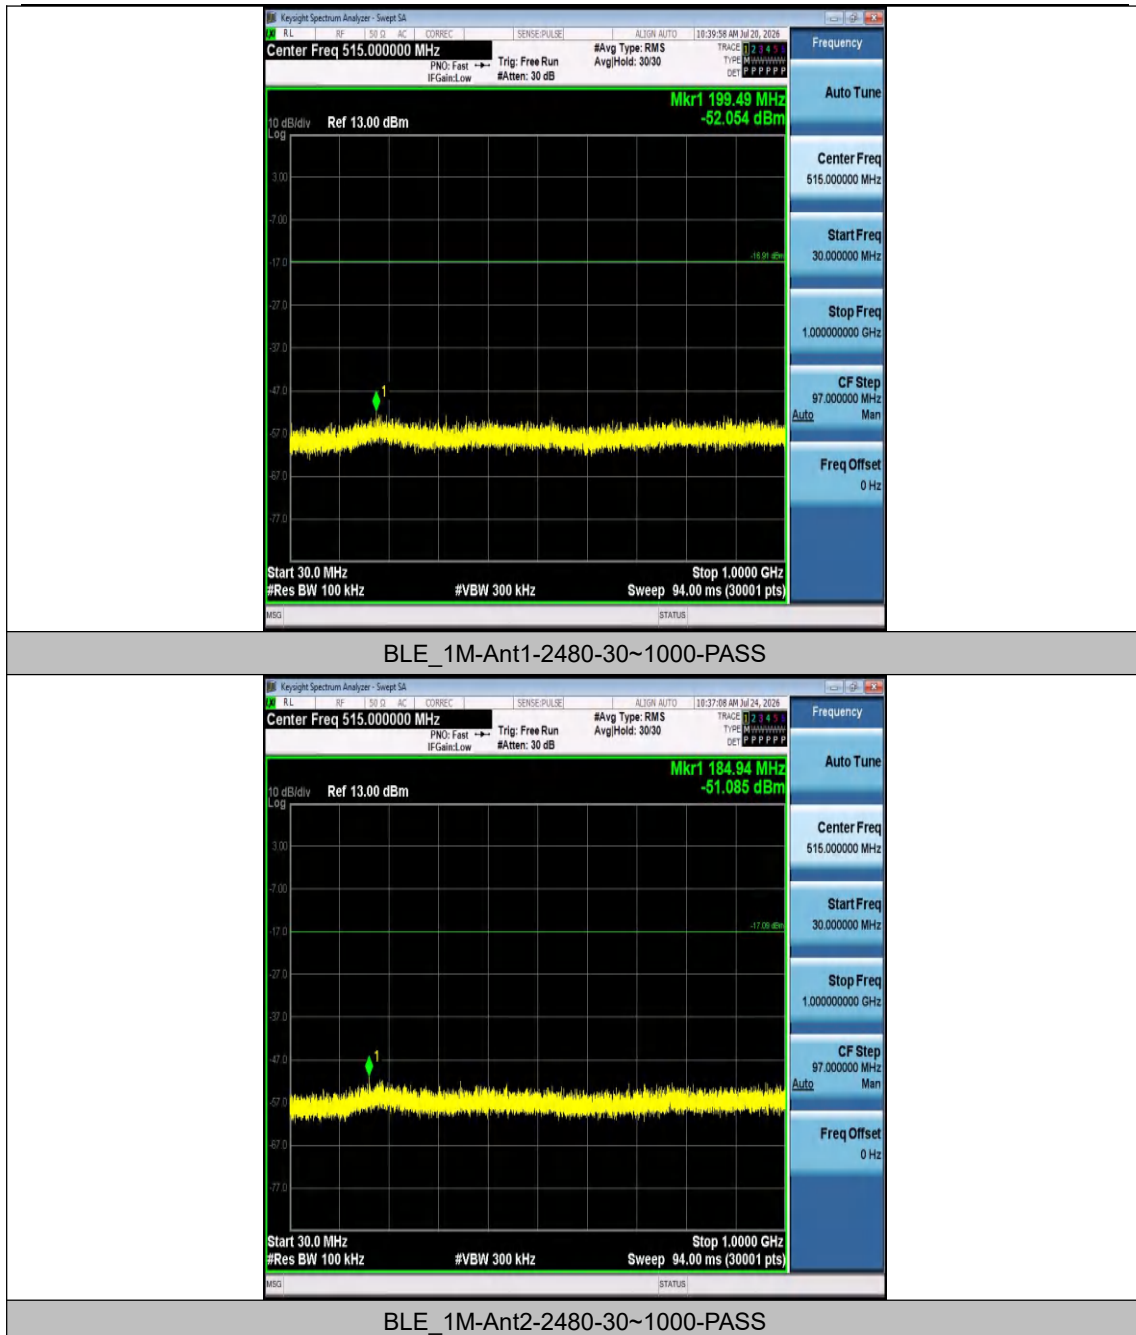

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

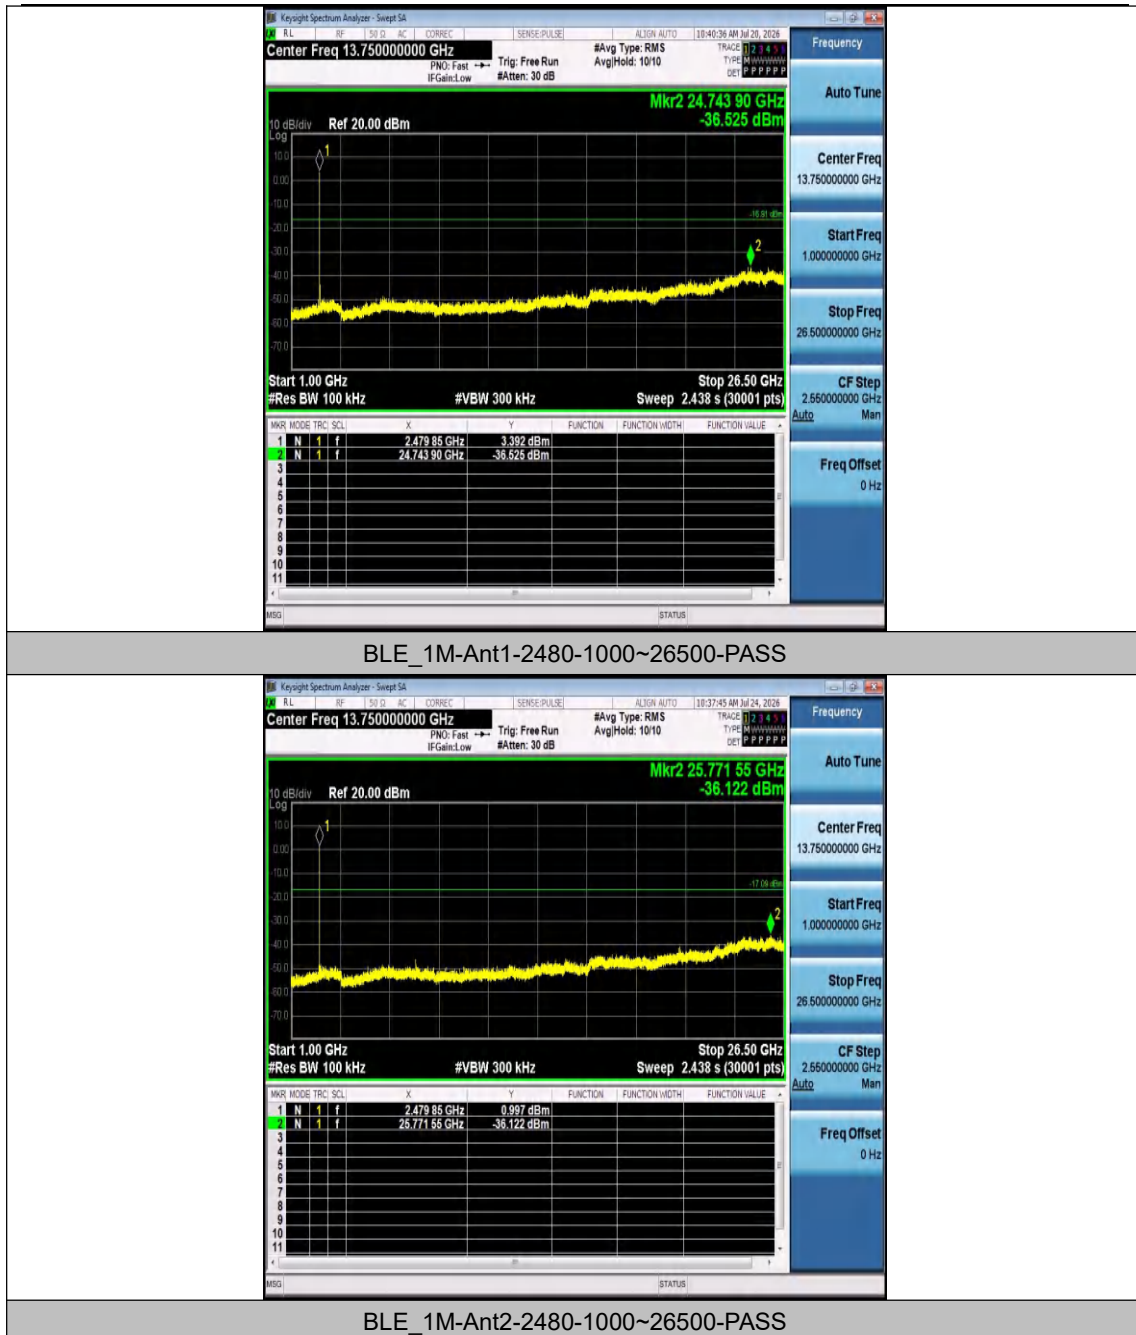

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

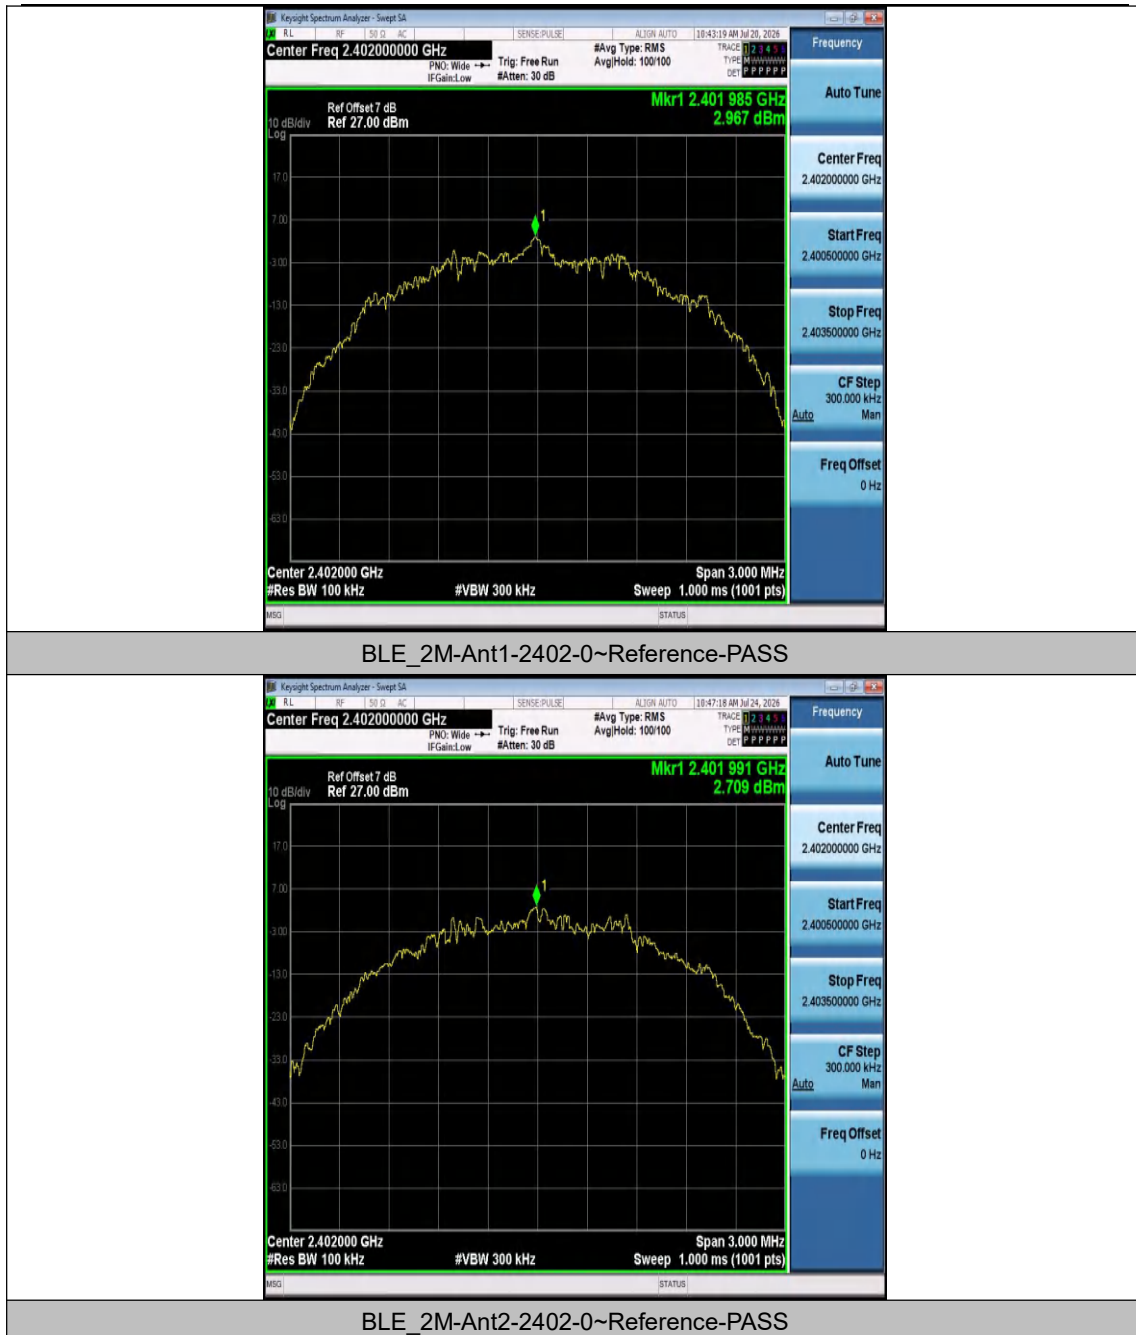

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

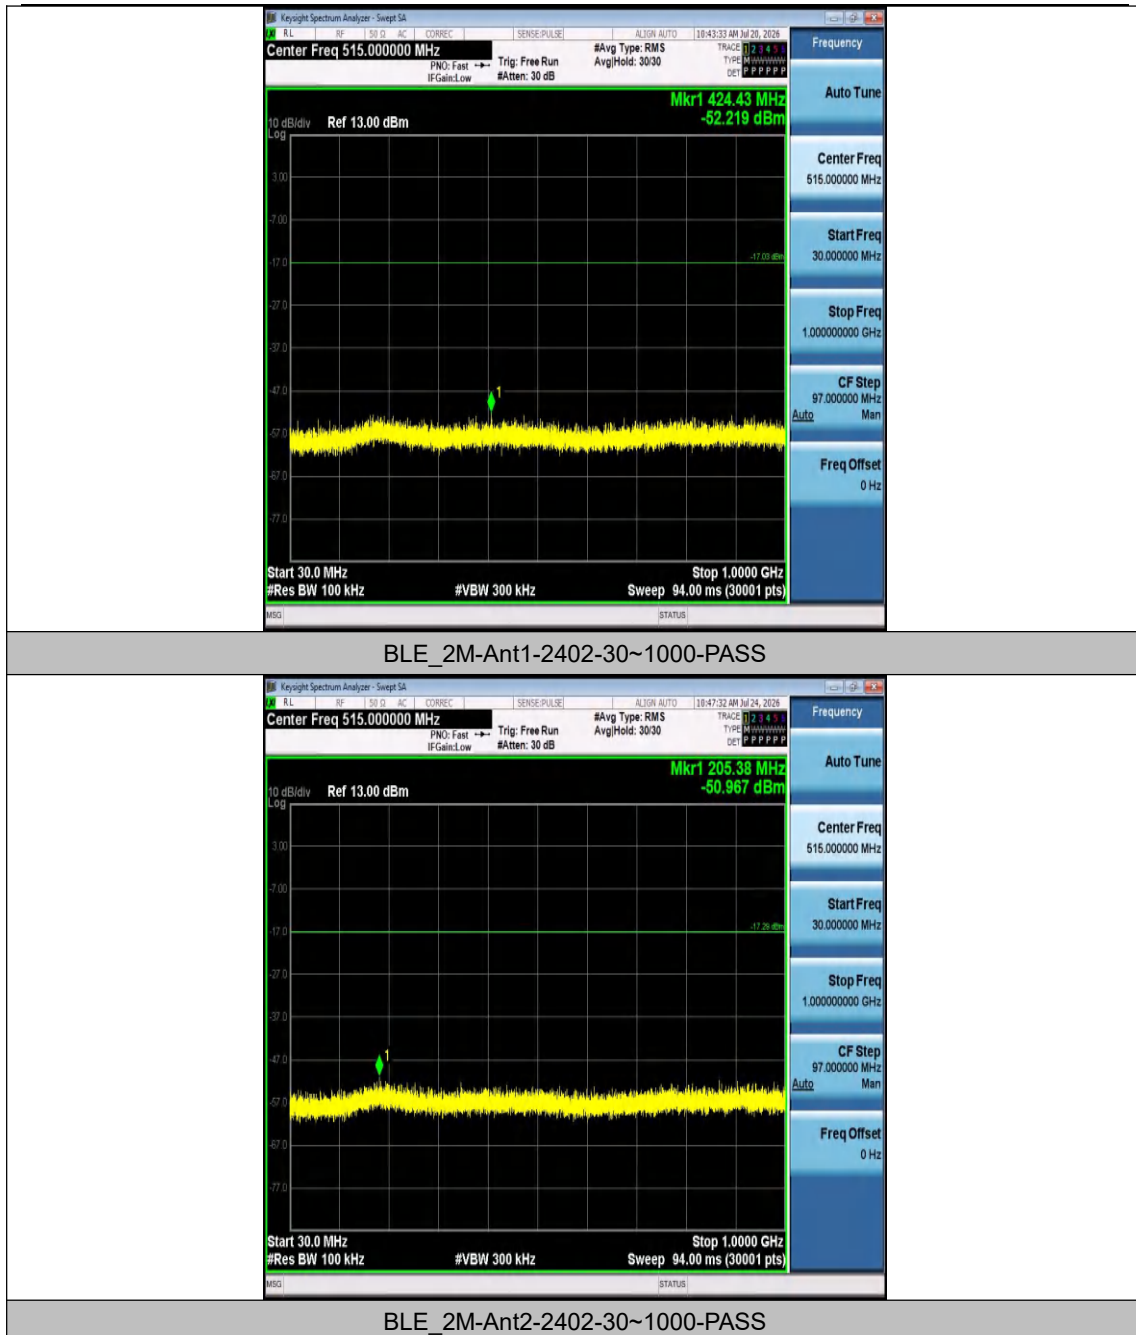

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

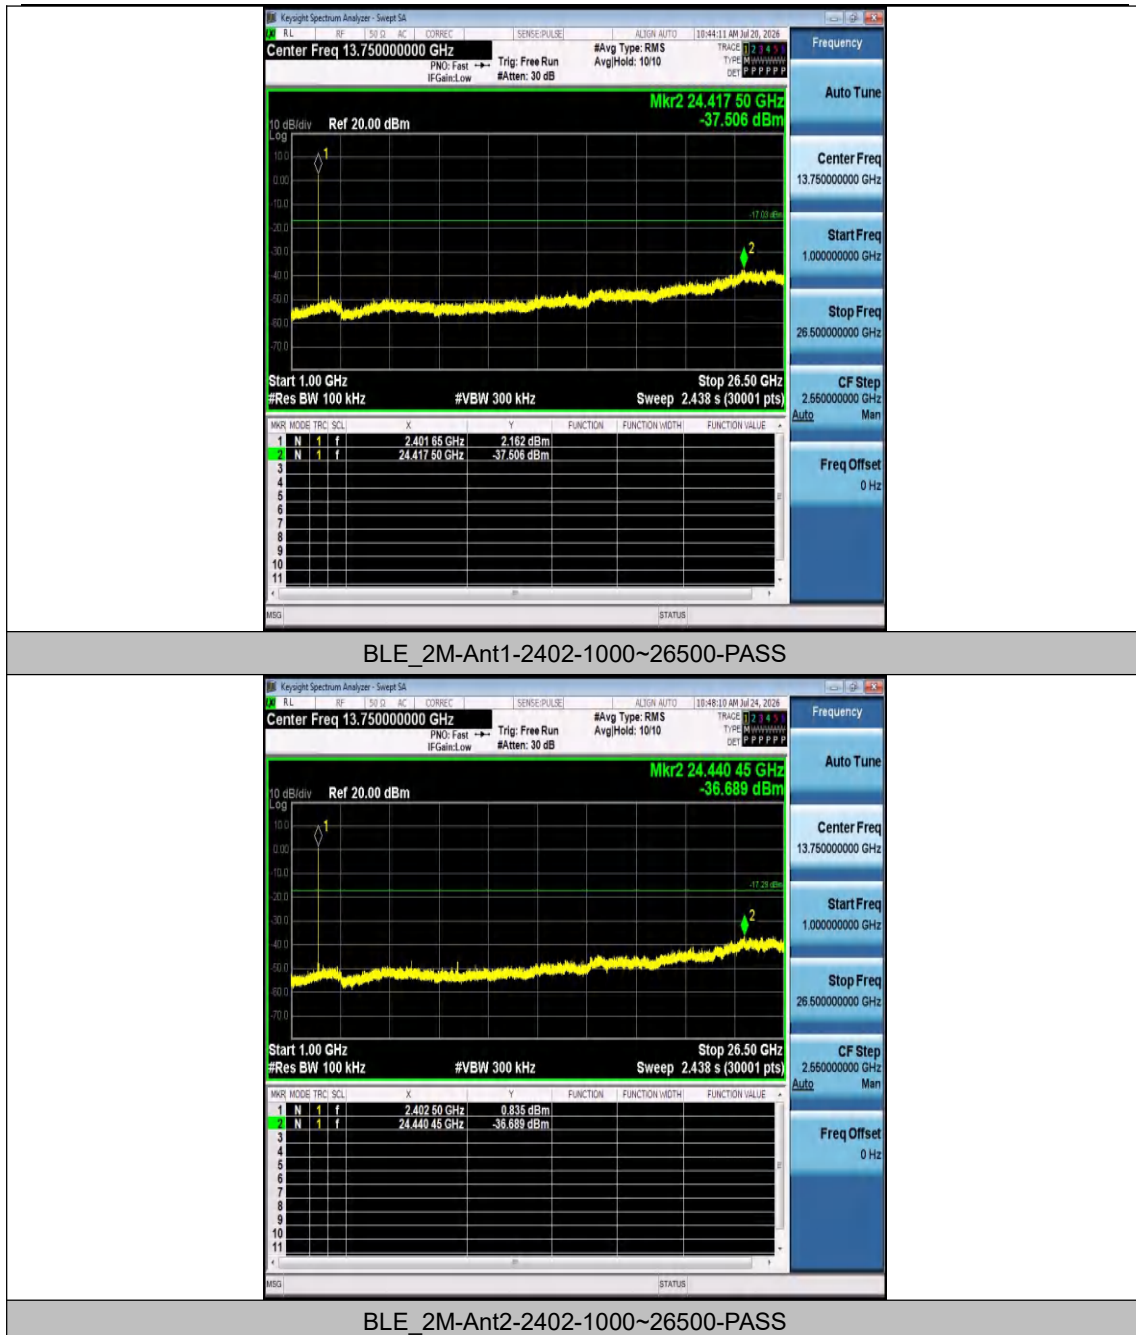

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

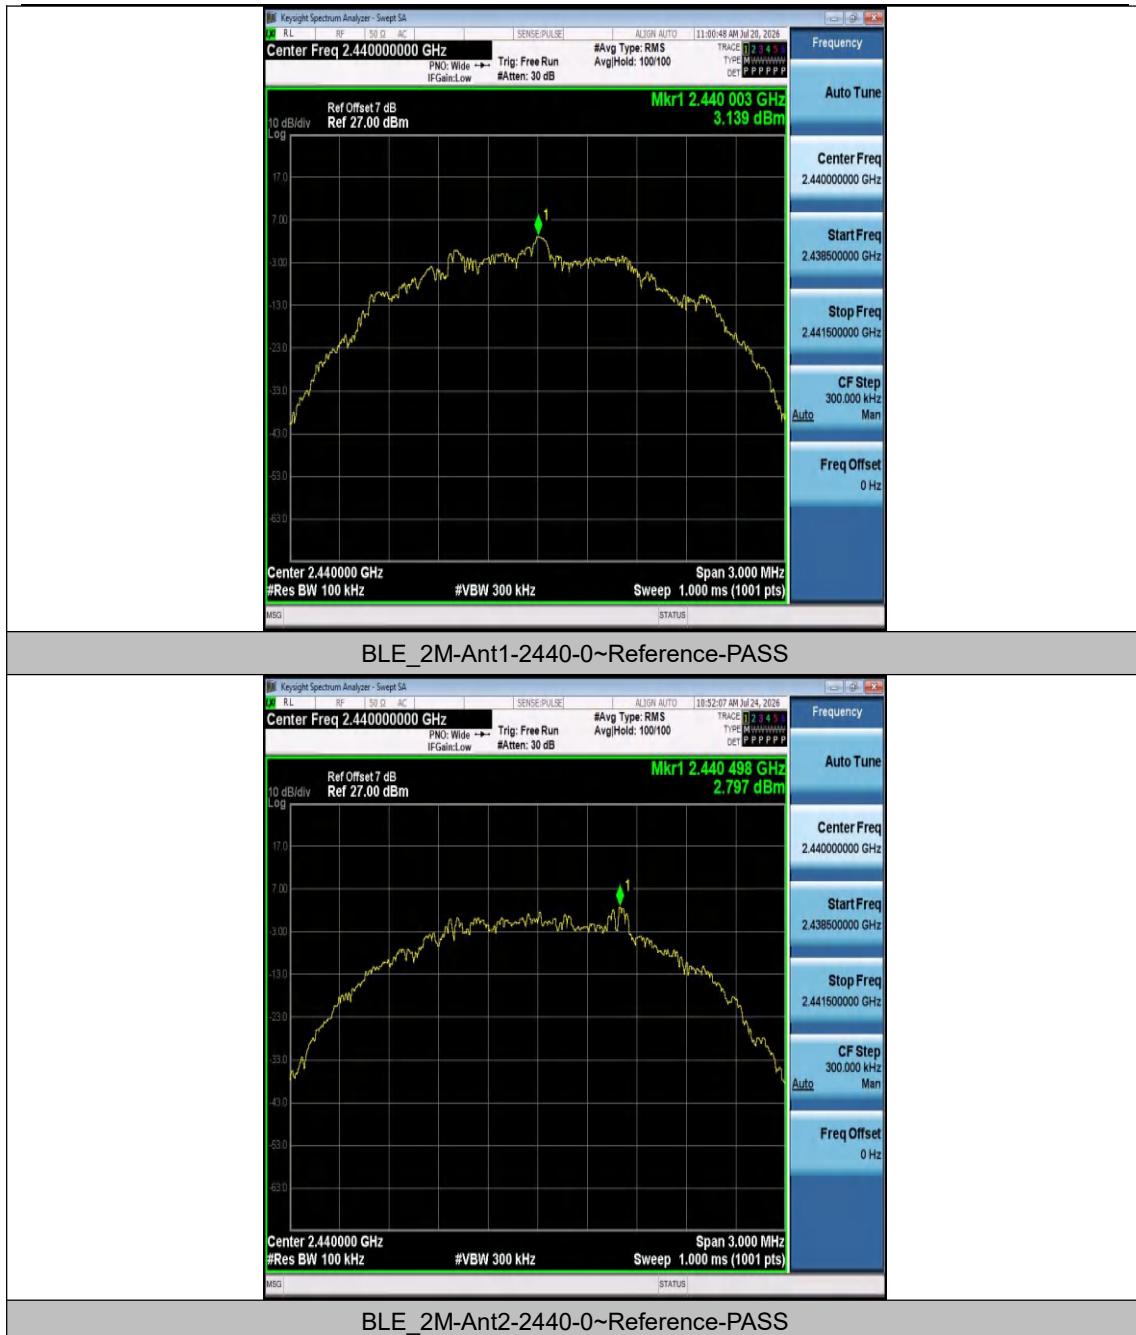

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

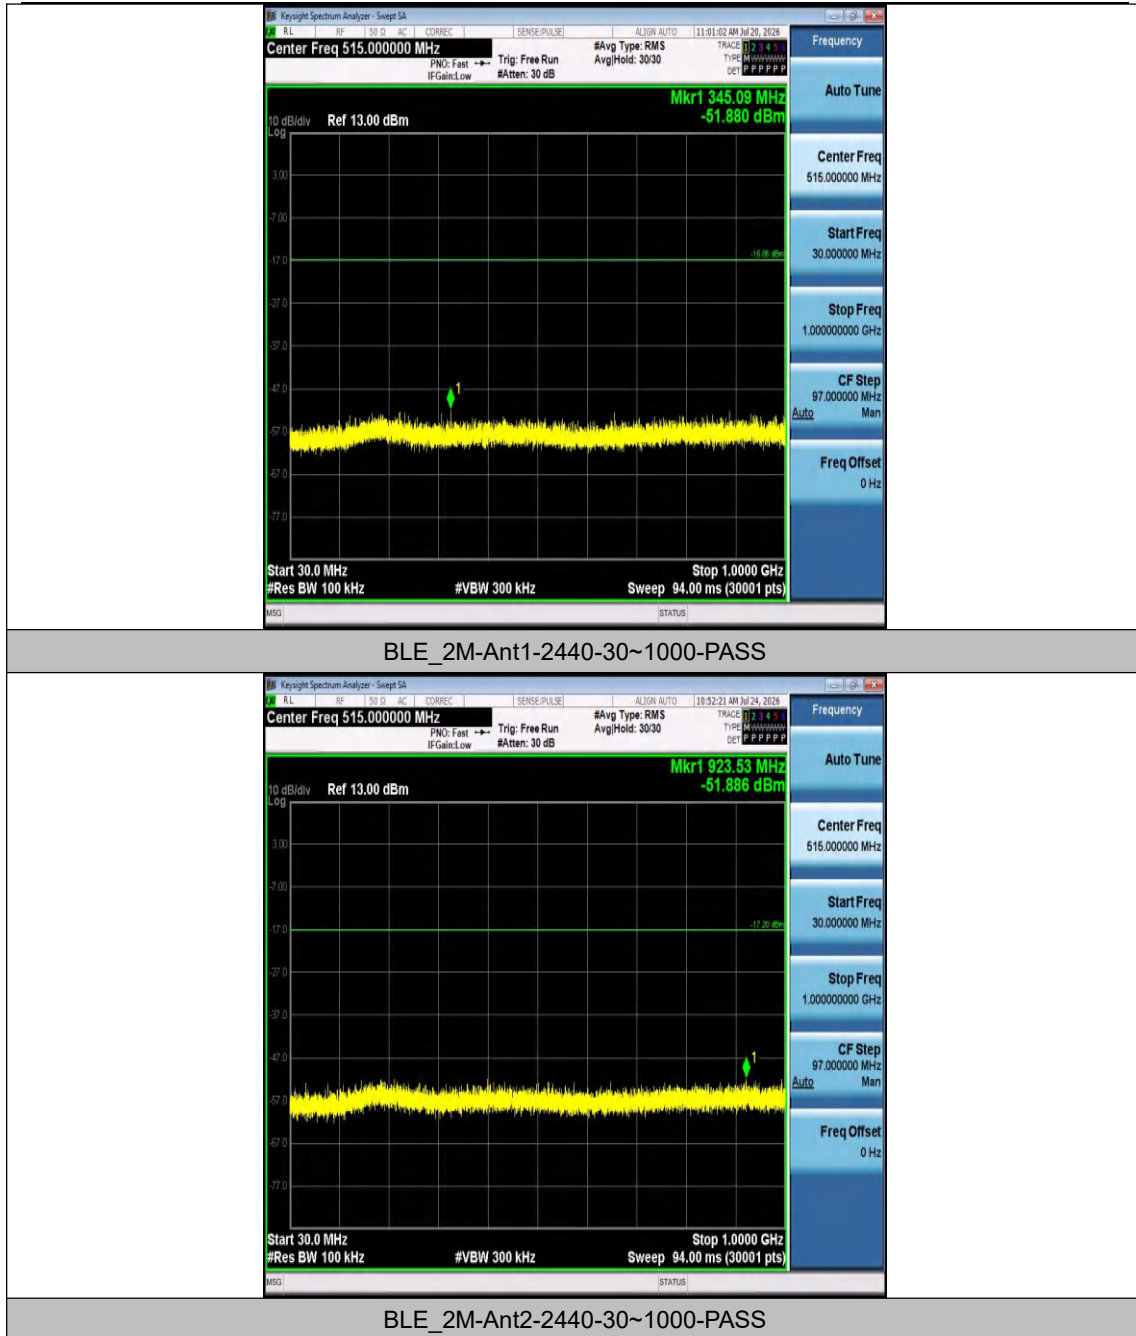

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

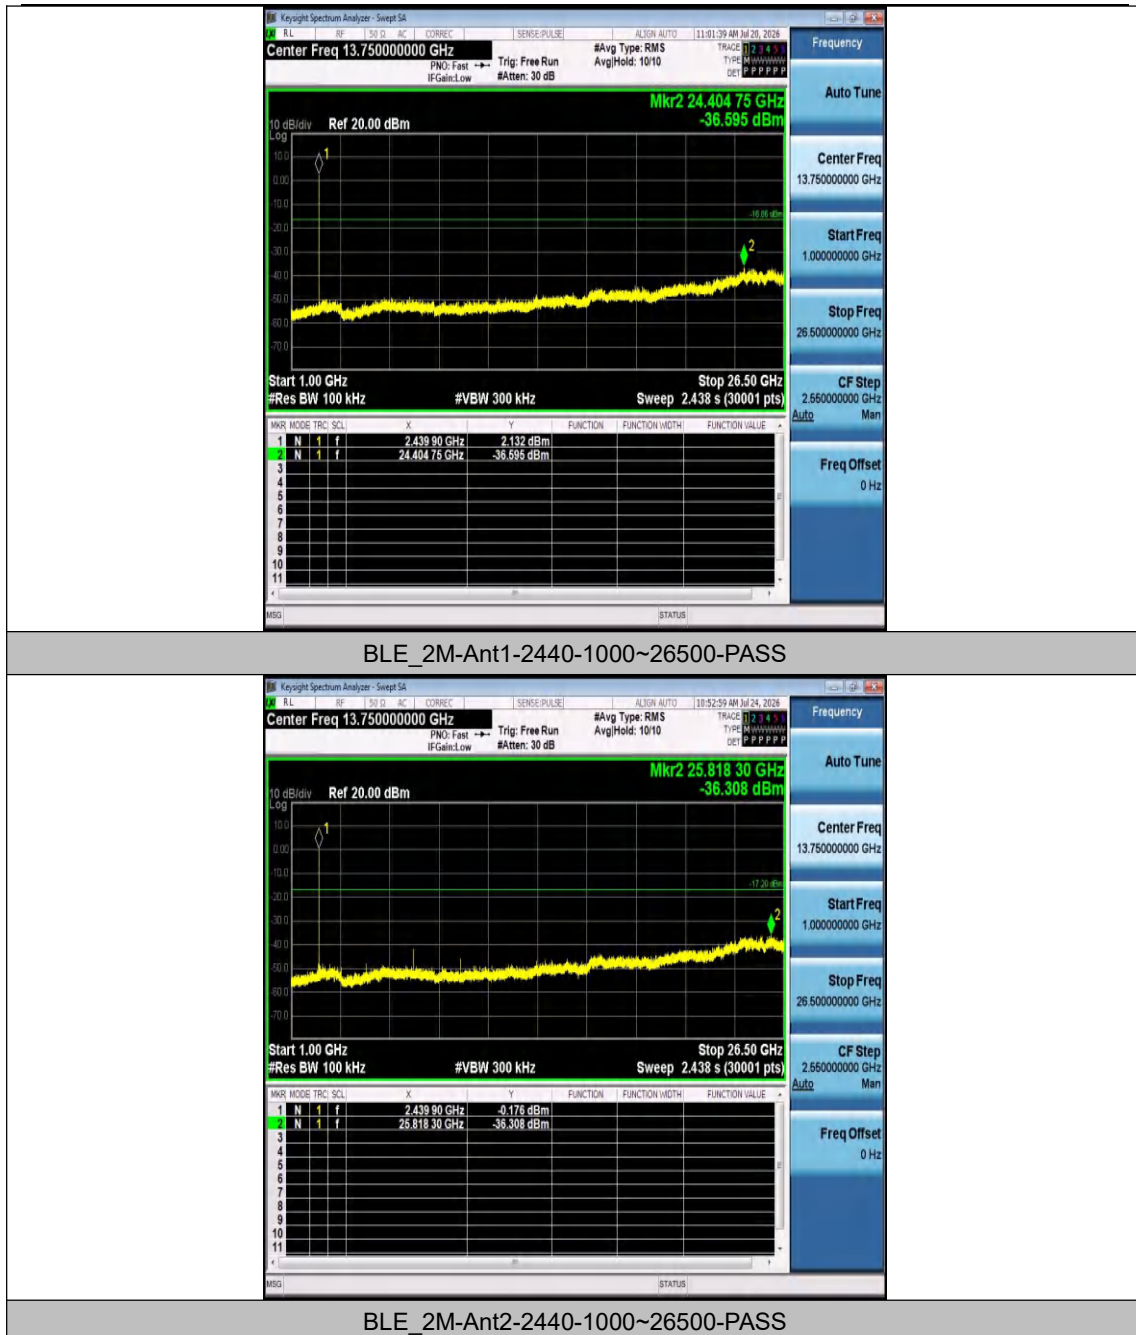

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

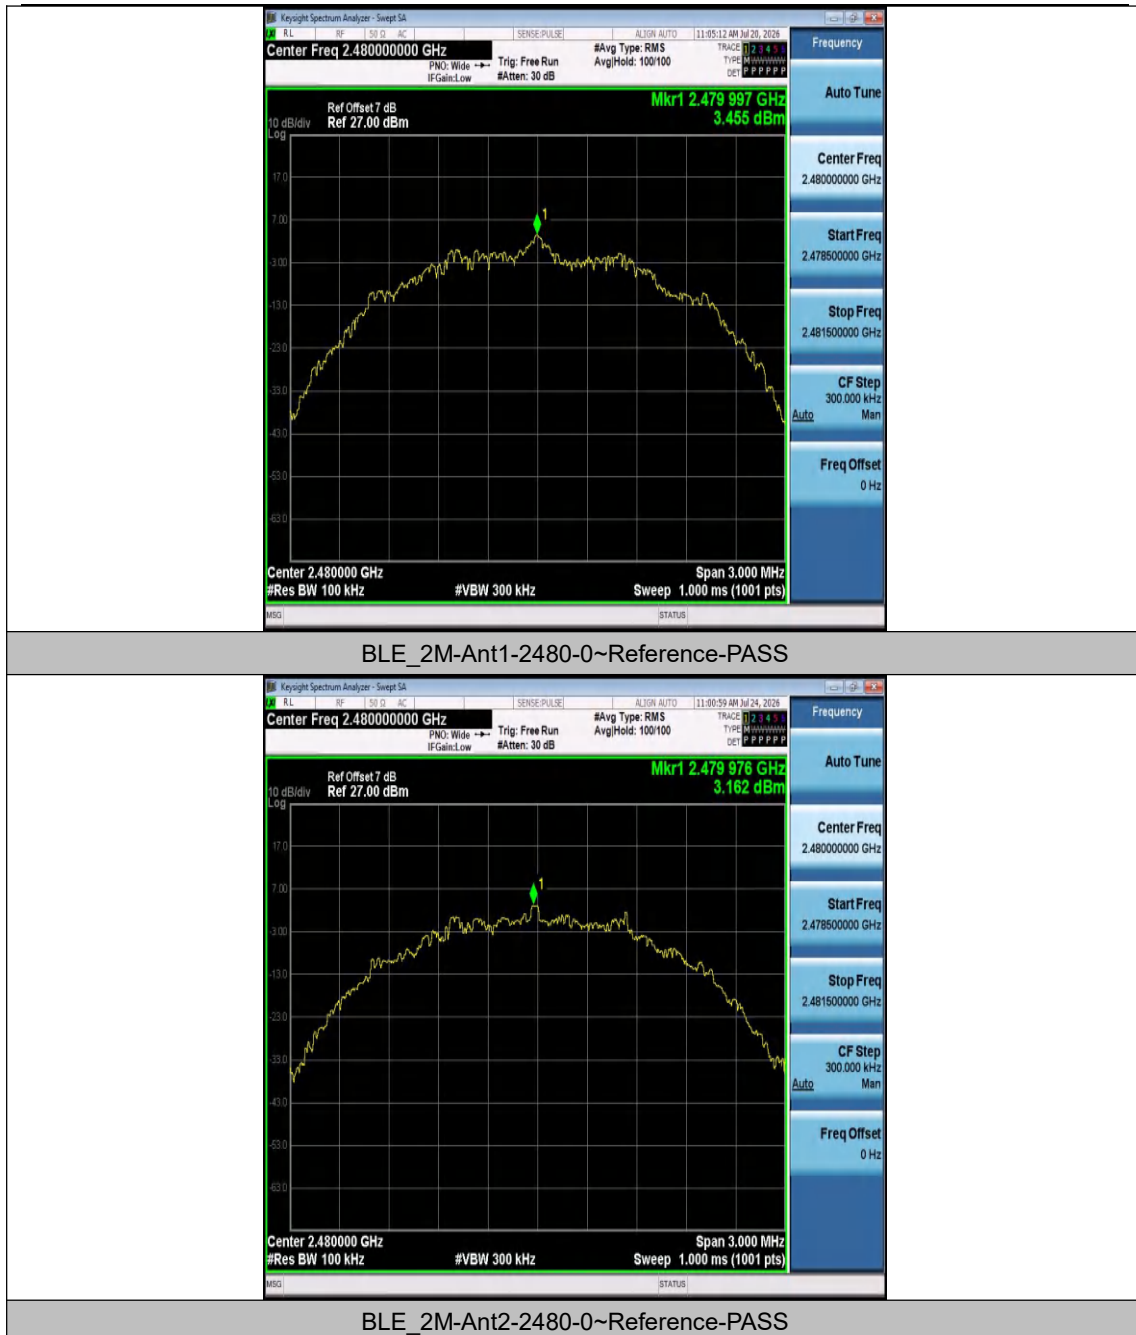

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

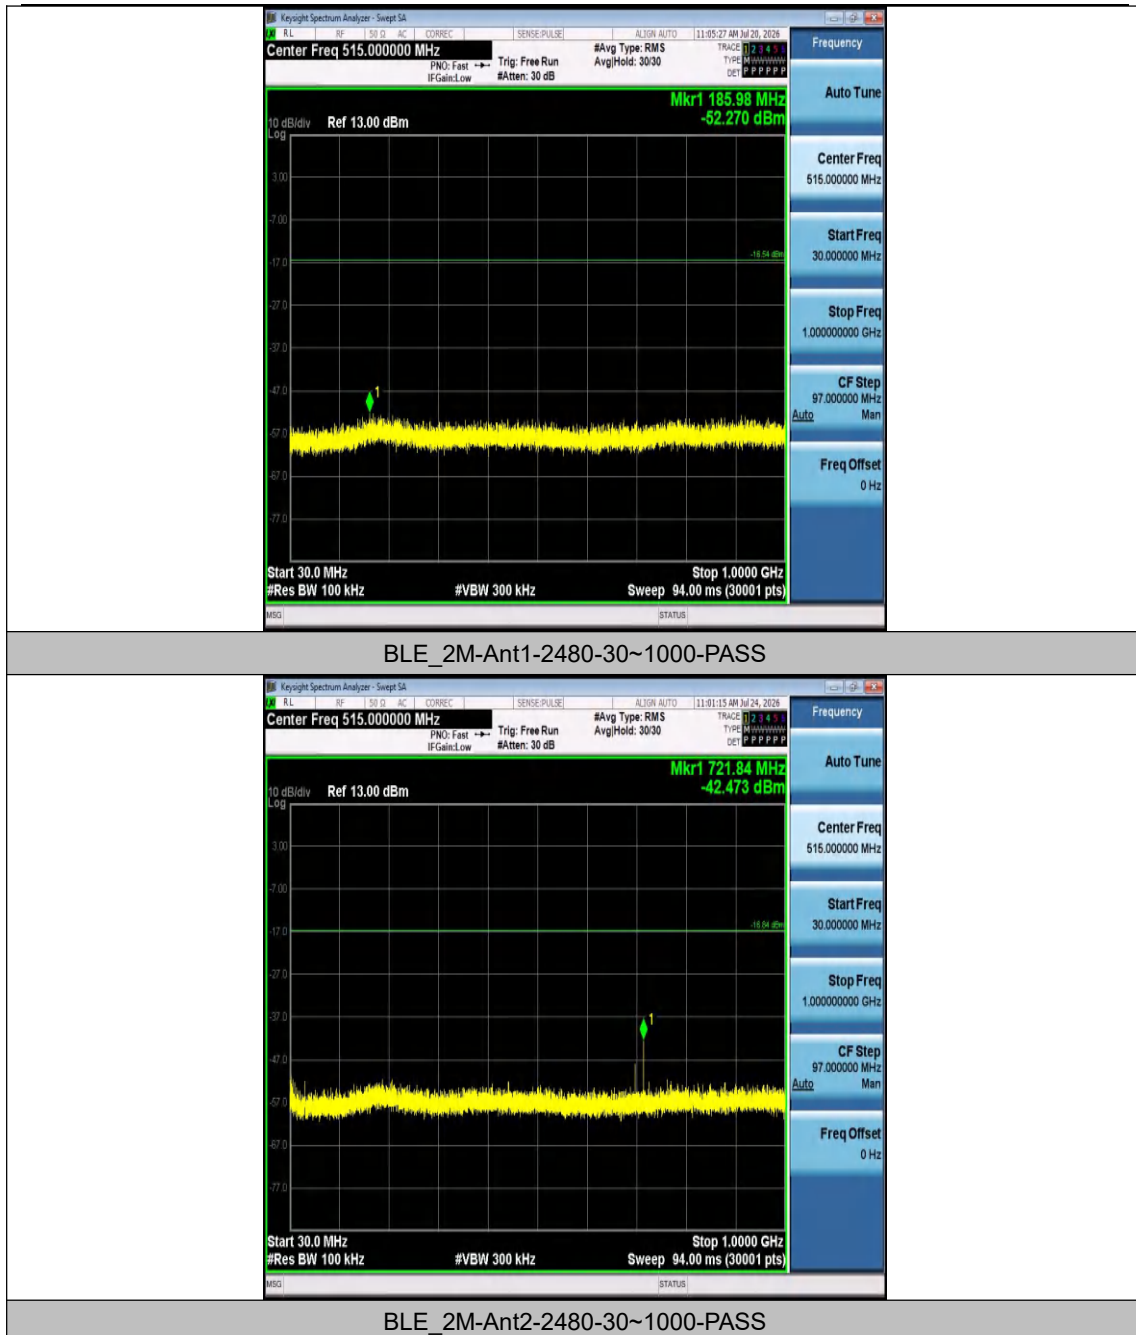

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

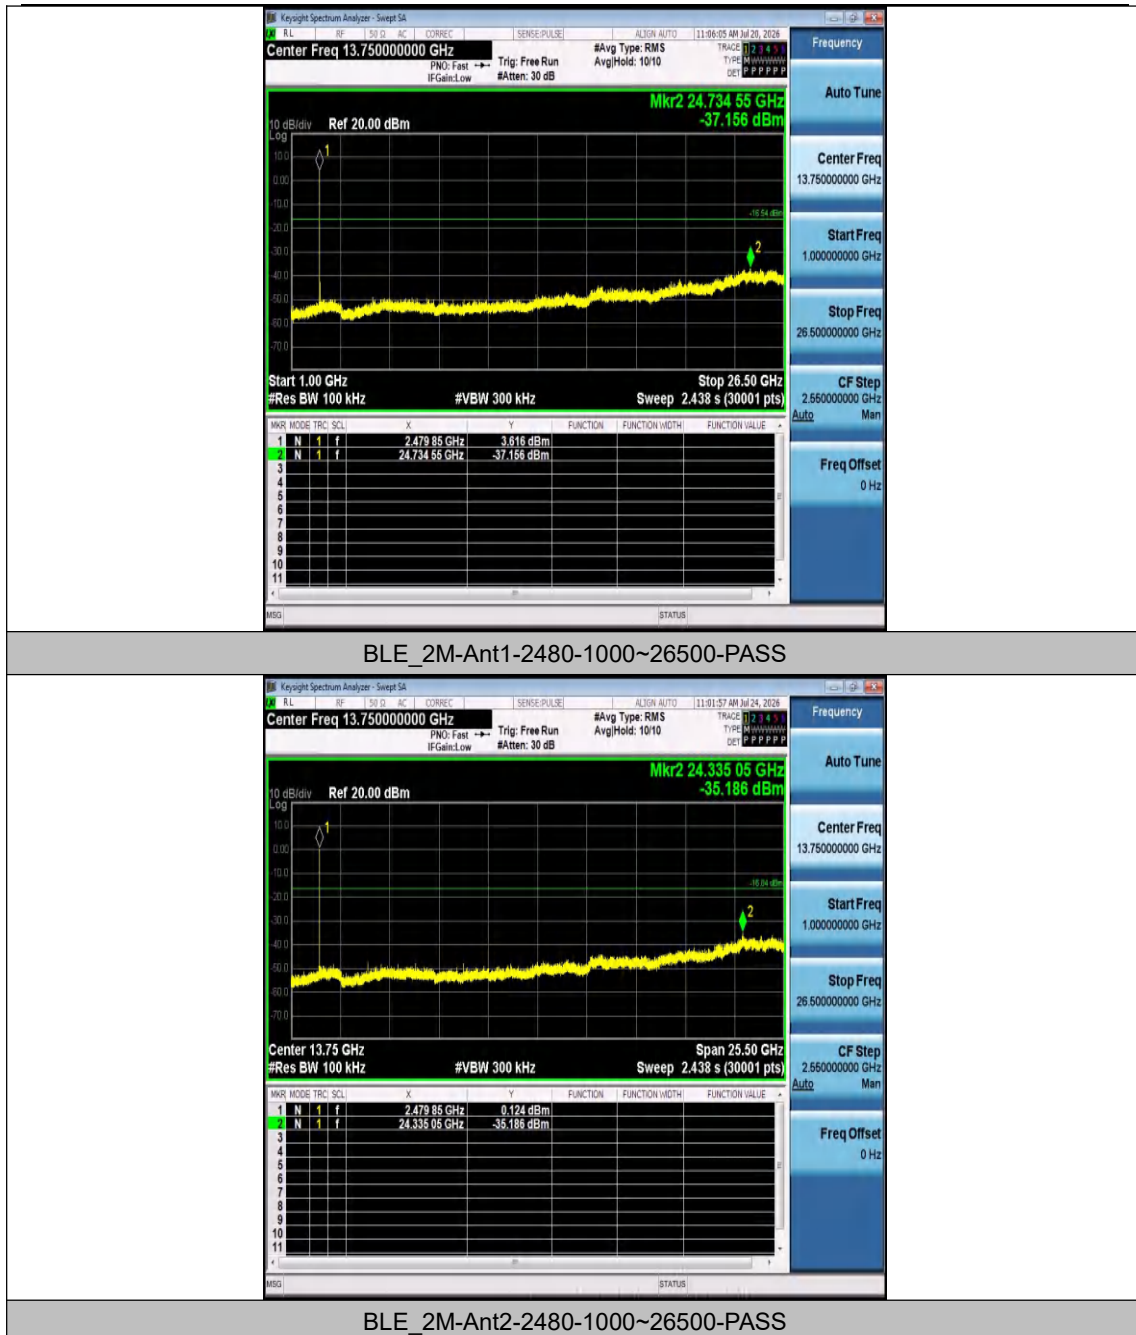

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix G: Duty Cycle


Test Result


Test Mode	Antenna	Frequency [MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
BLE_1M	Ant2	2402	2.13	2.49	85.54	0.68
BLE_1M	Ant1	2402	2.13	2.51	84.86	0.71
BLE_1M	Ant1	2440	2.13	2.49	85.54	0.68
BLE_1M	Ant2	2440	2.13	2.49	85.54	0.68
BLE_1M	Ant1	2480	2.13	2.50	85.20	0.70
BLE_1M	Ant2	2480	2.13	2.49	85.54	0.68
BLE_2M	Ant1	2402	1.08	2.50	43.20	3.65
BLE_2M	Ant2	2402	1.10	2.50	44.00	3.57
BLE_2M	Ant1	2440	1.10	2.50	44.00	3.57
BLE_2M	Ant2	2440	1.10	2.50	44.00	3.57
BLE_2M	Ant1	2480	1.10	2.50	44.00	3.57
BLE_2M	Ant2	2480	1.10	2.50	44.00	3.57


Test Graphs

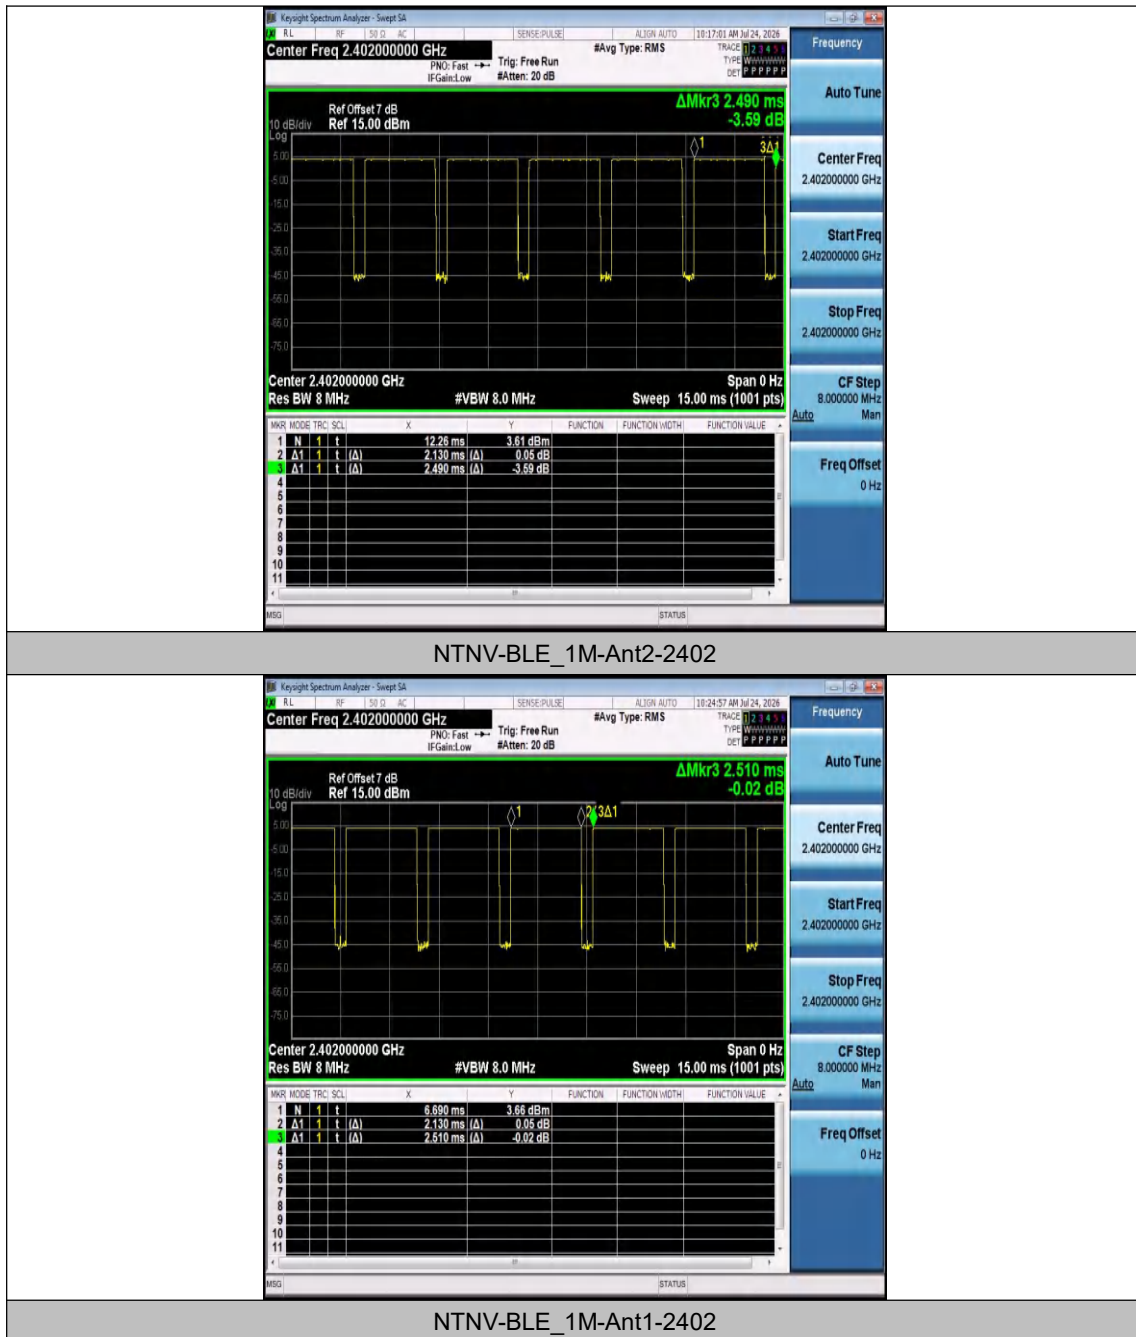


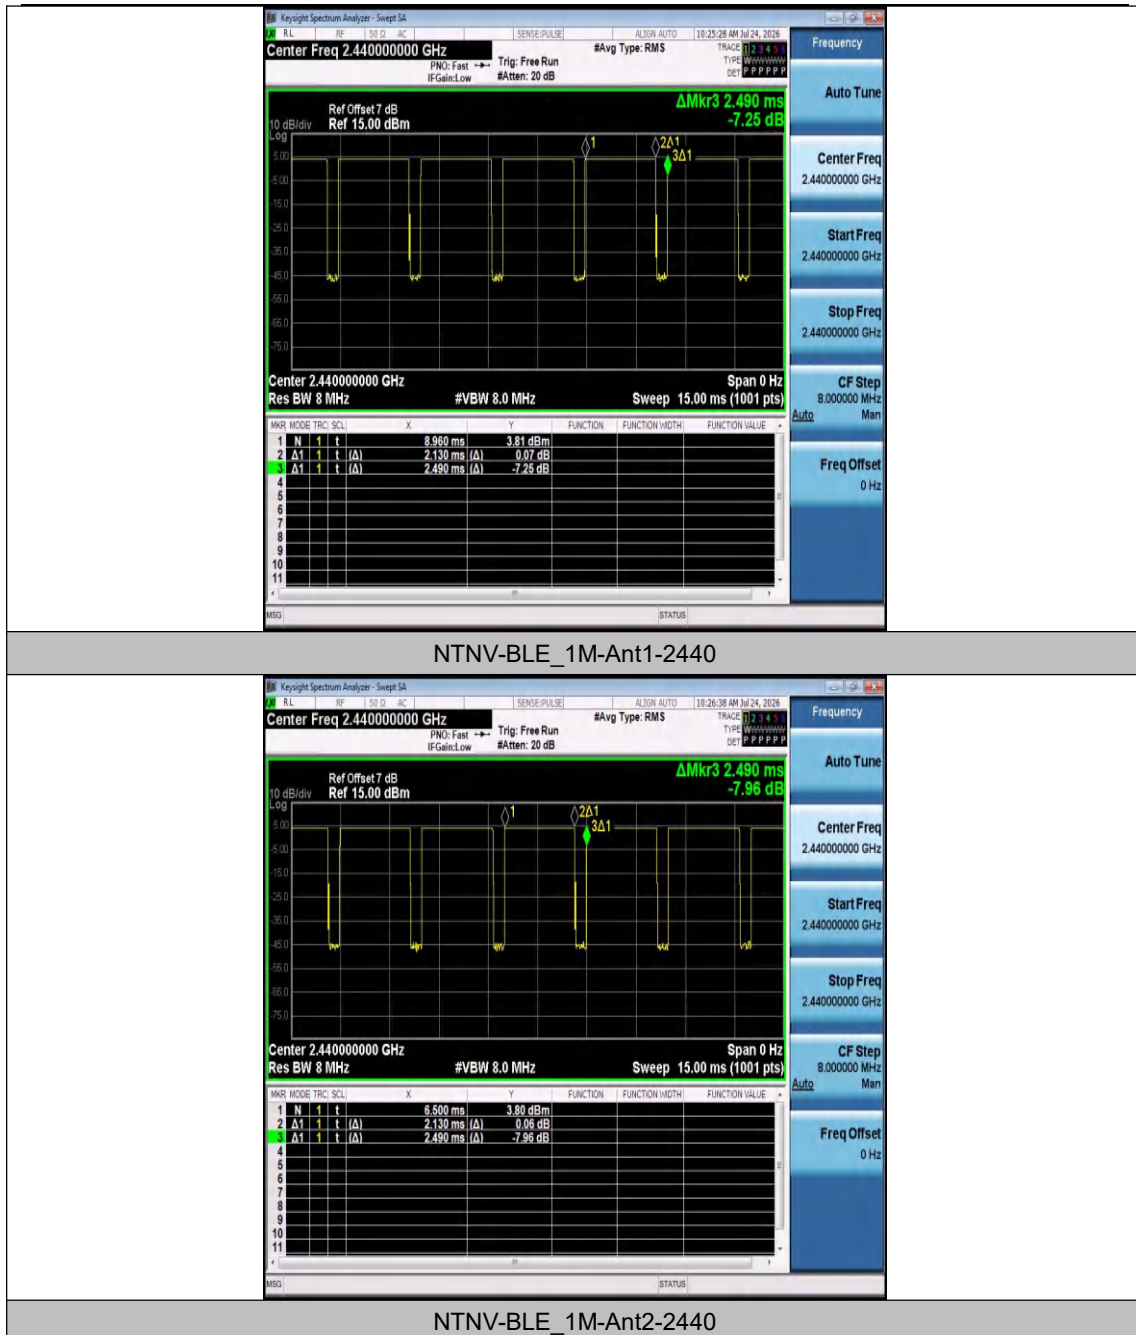

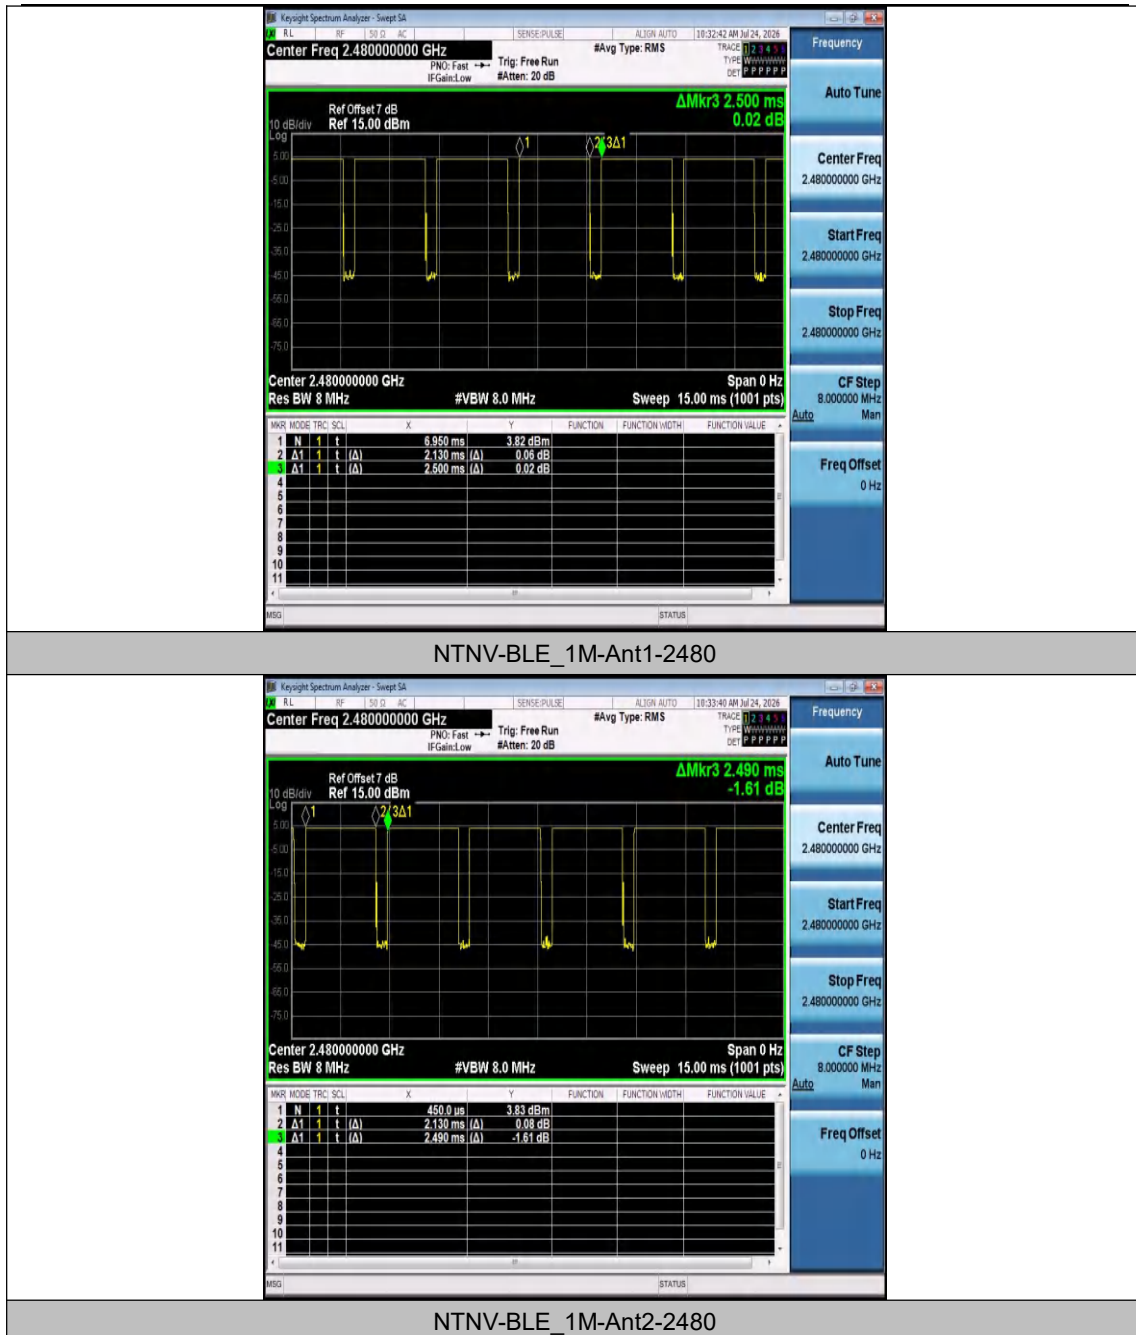

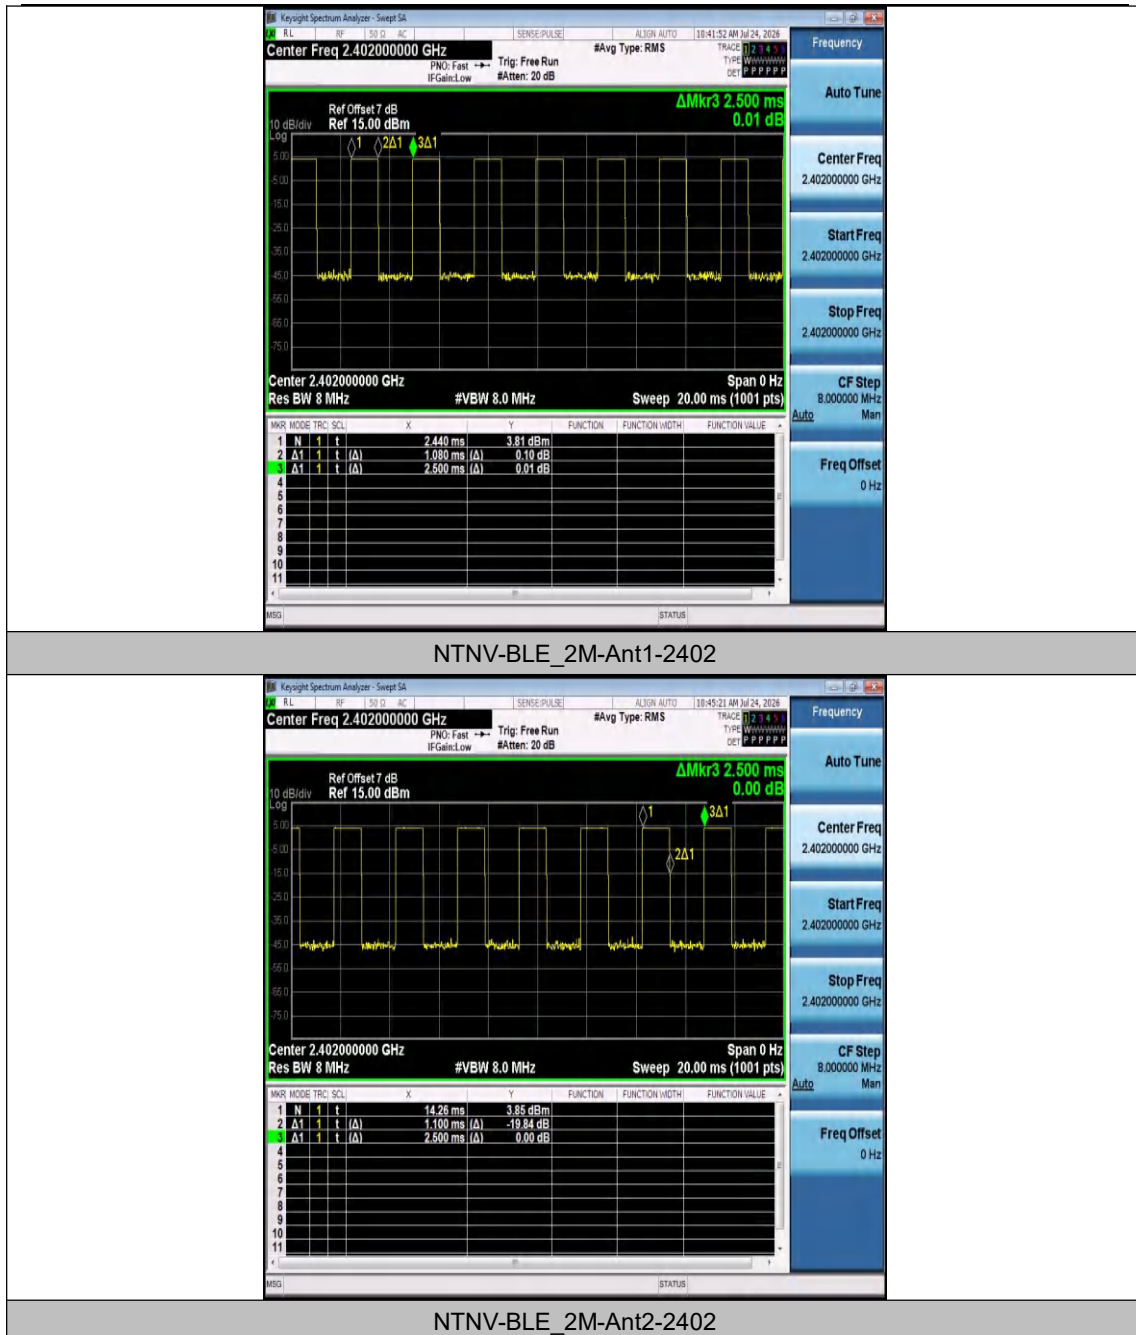

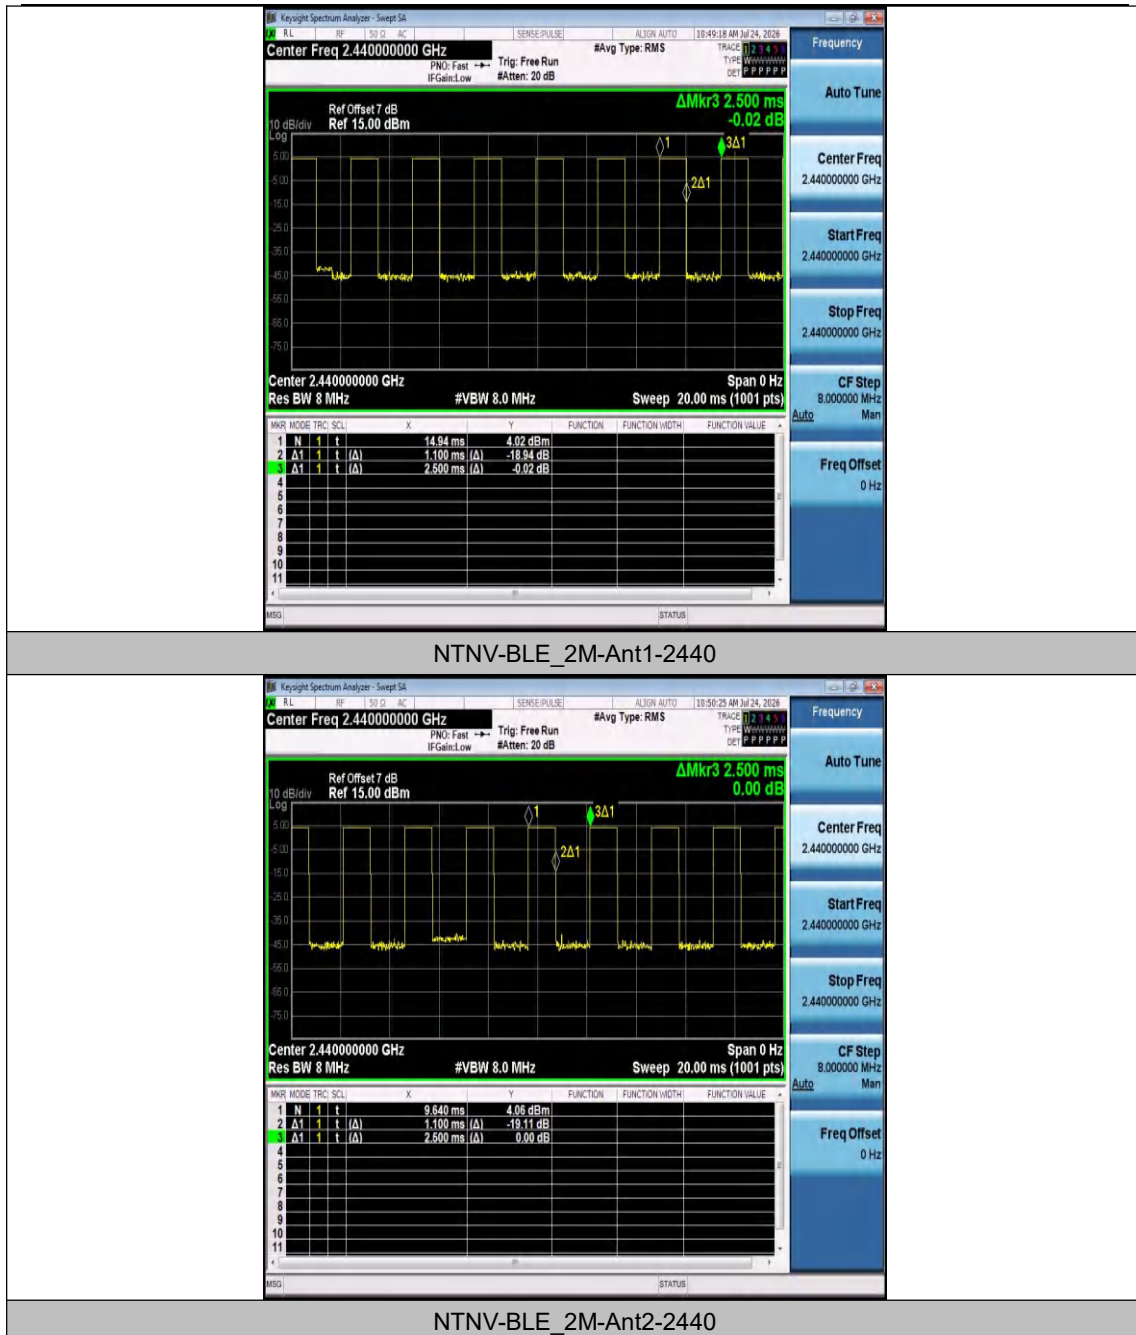

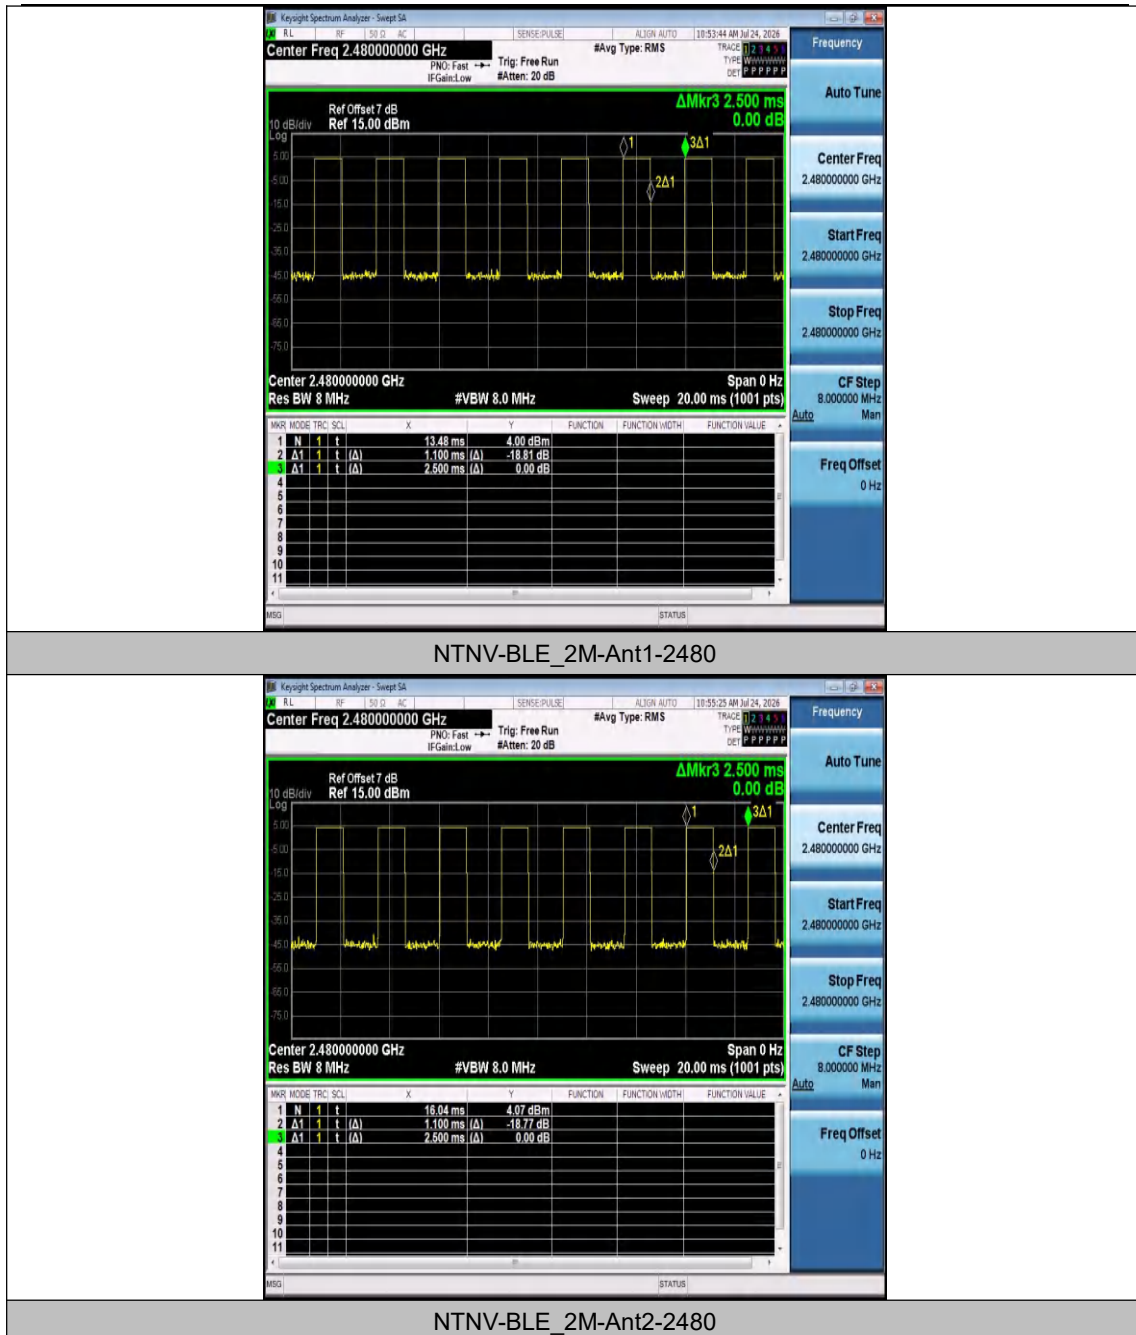

---End---