

Appendix Test Data

Report No.:	1812C60388012504-01	Test Sample No.:	1-2-2
Start Test Date:	2026-7-16	Finish Test Date:	2026-7-20
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	24°C	Relative Humidity:	64%
Pressure:	99.9kPa		



Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	22.840	5168.640	5191.480	---	---
11A	Ant2	5180	23.000	5168.560	5191.560	---	---
11A	Ant1	5220	22.520	5208.960	5231.480	---	---
11A	Ant2	5220	23.320	5208.360	5231.680	---	---
11A	Ant1	5240	24.080	5227.960	5252.040	---	---
11A	Ant2	5240	23.160	5228.680	5251.840	---	---
11A	Ant1	5745	23.720	5733.400	5757.120	---	---
11A	Ant2	5745	24.640	5732.560	5757.200	---	---
11A	Ant1	5785	23.840	5773.480	5797.320	---	---
11A	Ant2	5785	23.840	5773.200	5797.040	---	---
11A	Ant1	5825	24.160	5813.080	5837.240	---	---
11A	Ant2	5825	24.040	5812.600	5836.640	---	---
11N20SISO	Ant1	5180	23.640	5168.240	5191.880	---	---
11N20SISO	Ant2	5180	23.680	5168.280	5191.960	---	---
11N20SISO	Ant1	5220	23.600	5208.320	5231.920	---	---
11N20SISO	Ant2	5220	23.400	5208.320	5231.720	---	---
11N20SISO	Ant1	5240	23.280	5228.400	5251.680	---	---
11N20SISO	Ant2	5240	24.520	5227.960	5252.480	---	---
11N20SISO	Ant1	5745	24.360	5732.960	5757.320	---	---
11N20SISO	Ant2	5745	24.280	5733.160	5757.440	---	---
11N20SISO	Ant1	5785	24.440	5772.720	5797.160	---	---
11N20SISO	Ant2	5785	25.080	5772.520	5797.600	---	---
11N20SISO	Ant1	5825	24.600	5812.800	5837.400	---	---
11N20SISO	Ant2	5825	24.240	5812.920	5837.160	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11N40SISO	Ant1	5190	42.800	5168.800	5211.600	---	---
11N40SISO	Ant2	5190	43.840	5168.880	5212.720	---	---
11N40SISO	Ant1	5230	43.760	5208.480	5252.240	---	---
11N40SISO	Ant2	5230	42.960	5208.320	5251.280	---	---
11N40SISO	Ant1	5755	45.680	5732.360	5778.040	---	---
11N40SISO	Ant2	5755	43.200	5733.400	5776.600	---	---
11N40SISO	Ant1	5795	44.000	5773.000	5817.000	---	---
11N40SISO	Ant2	5795	43.680	5773.560	5817.240	---	---
11AC20SISO	Ant1	5180	23.680	5168.360	5192.040	---	---
11AC20SISO	Ant2	5180	23.760	5168.240	5192.000	---	---
11AC20SISO	Ant1	5220	24.200	5207.680	5231.880	---	---
11AC20SISO	Ant2	5220	23.760	5208.360	5232.120	---	---
11AC20SISO	Ant1	5240	23.520	5228.440	5251.960	---	---
11AC20SISO	Ant2	5240	23.400	5228.400	5251.800	---	---
11AC20SISO	Ant2	5745	24.560	5732.680	5757.240	---	---
11AC20SISO	Ant1	5745	24.600	5732.760	5757.360	---	---
11AC20SISO	Ant2	5785	24.280	5772.760	5797.040	---	---
11AC20SISO	Ant1	5785	24.800	5772.640	5797.440	---	---
11AC20SISO	Ant2	5825	24.720	5812.200	5836.920	---	---
11AC20SISO	Ant1	5825	23.880	5812.880	5836.760	---	---
11AC40SISO	Ant1	5190	42.880	5168.480	5211.360	---	---
11AC40SISO	Ant2	5190	43.440	5168.640	5212.080	---	---
11AC40SISO	Ant1	5230	42.720	5208.640	5251.360	---	---
11AC40SISO	Ant2	5230	44.320	5207.440	5251.760	---	---
11AC40SISO	Ant2	5755	44.160	5732.600	5776.760	---	---
11AC40SISO	Ant1	5755	43.200	5733.240	5776.440	---	---
11AC40SISO	Ant2	5795	43.440	5773.400	5816.840	---	---
11AC40SISO	Ant1	5795	44.560	5772.680	5817.240	---	---
11AC80SISO	Ant1	5210	83.680	5168.880	5252.560	---	---
11AC80SISO	Ant2	5210	83.520	5168.560	5252.080	---	---
11AC80SISO	Ant2	5775	84.000	5732.600	5816.600	---	---
11AC80SISO	Ant1	5775	82.720	5734.040	5816.760	---	---
11AX20SISO	Ant1	5180	22.480	5168.920	5191.400	---	---
11AX20SISO	Ant2	5180	23.280	5168.360	5191.640	---	---
11AX20SISO	Ant1	5220	23.800	5207.840	5231.640	---	---
11AX20SISO	Ant2	5220	24.000	5207.880	5231.880	---	---
11AX20SISO	Ant1	5240	23.160	5228.600	5251.760	---	---
11AX20SISO	Ant2	5240	23.720	5228.160	5251.880	---	---
11AX20SISO	Ant2	5745	23.200	5733.200	5756.400	---	---
11AX20SISO	Ant1	5745	23.600	5733.440	5757.040	---	---
11AX20SISO	Ant2	5785	23.880	5773.280	5797.160	---	---
11AX20SISO	Ant1	5785	23.400	5773.360	5796.760	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX20SISO	Ant2	5825	23.400	5813.440	5836.840	---	---
11AX20SISO	Ant1	5825	23.360	5813.560	5836.920	---	---
11AX40SISO	Ant1	5190	42.080	5169.040	5211.120	---	---
11AX40SISO	Ant2	5190	42.640	5169.280	5211.920	---	---
11AX40SISO	Ant1	5230	41.600	5209.600	5251.200	---	---
11AX40SISO	Ant2	5230	41.520	5209.200	5250.720	---	---
11AX40SISO	Ant2	5755	44.480	5733.080	5777.560	---	---
11AX40SISO	Ant1	5755	43.360	5733.160	5776.520	---	---
11AX40SISO	Ant2	5795	43.280	5773.480	5816.760	---	---
11AX40SISO	Ant1	5795	42.960	5773.640	5816.600	---	---
11AX80SISO	Ant1	5210	84.320	5168.400	5252.720	---	---
11AX80SISO	Ant2	5210	84.160	5168.080	5252.240	---	---
11AX80SISO	Ant2	5775	82.880	5733.560	5816.440	---	---
11AX80SISO	Ant1	5775	83.680	5733.240	5816.920	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

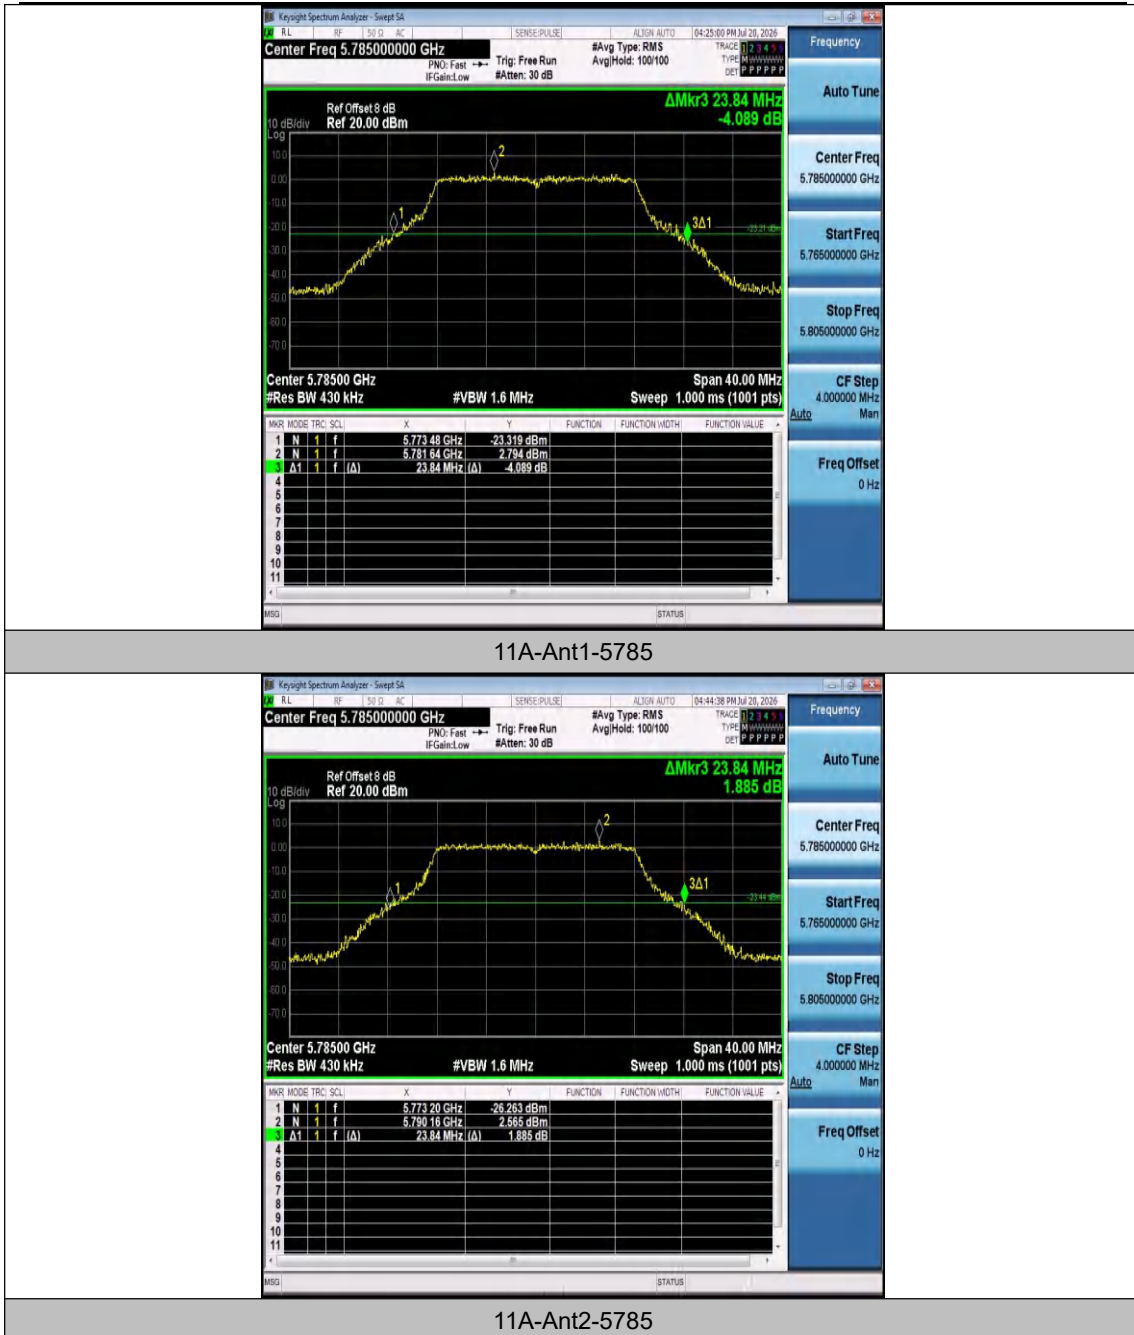

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com











Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




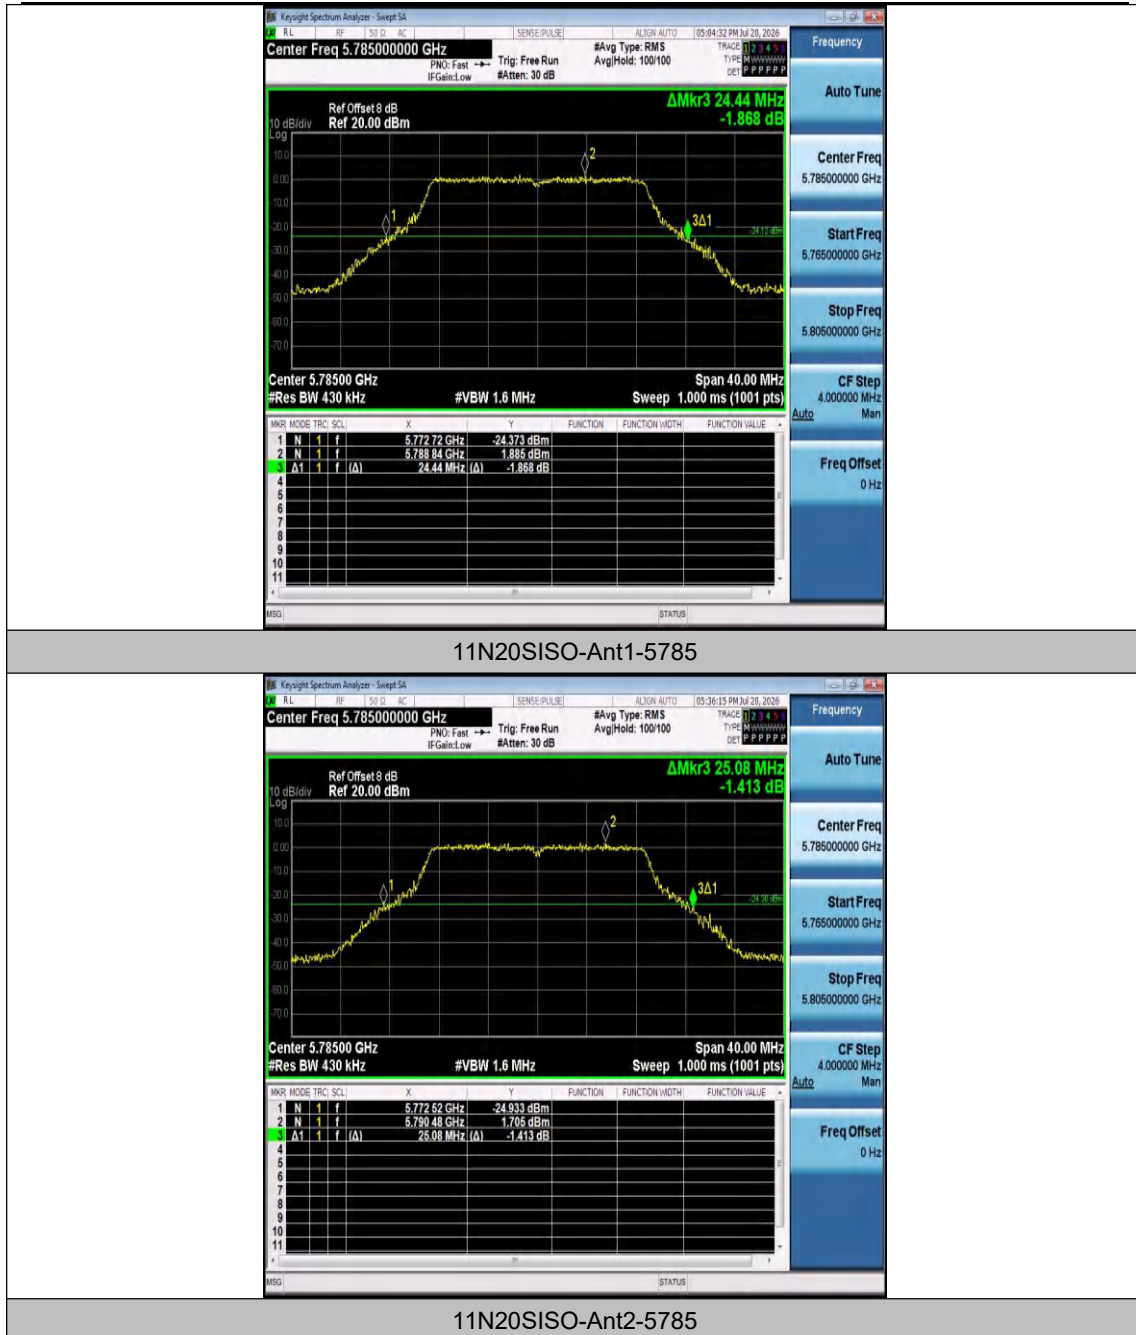


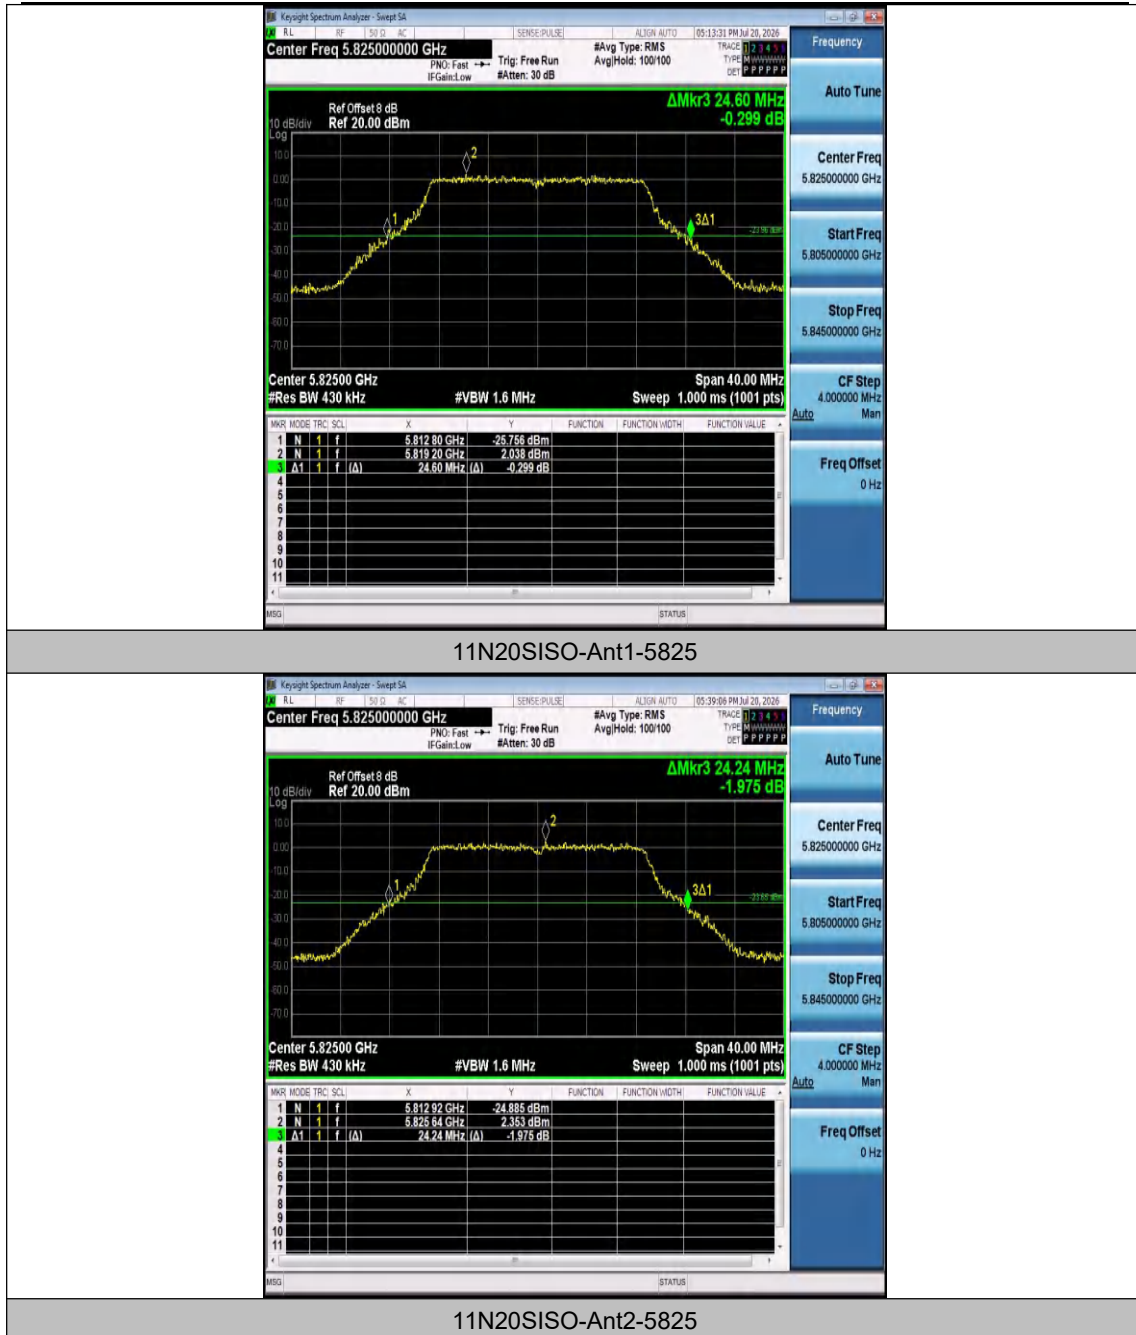

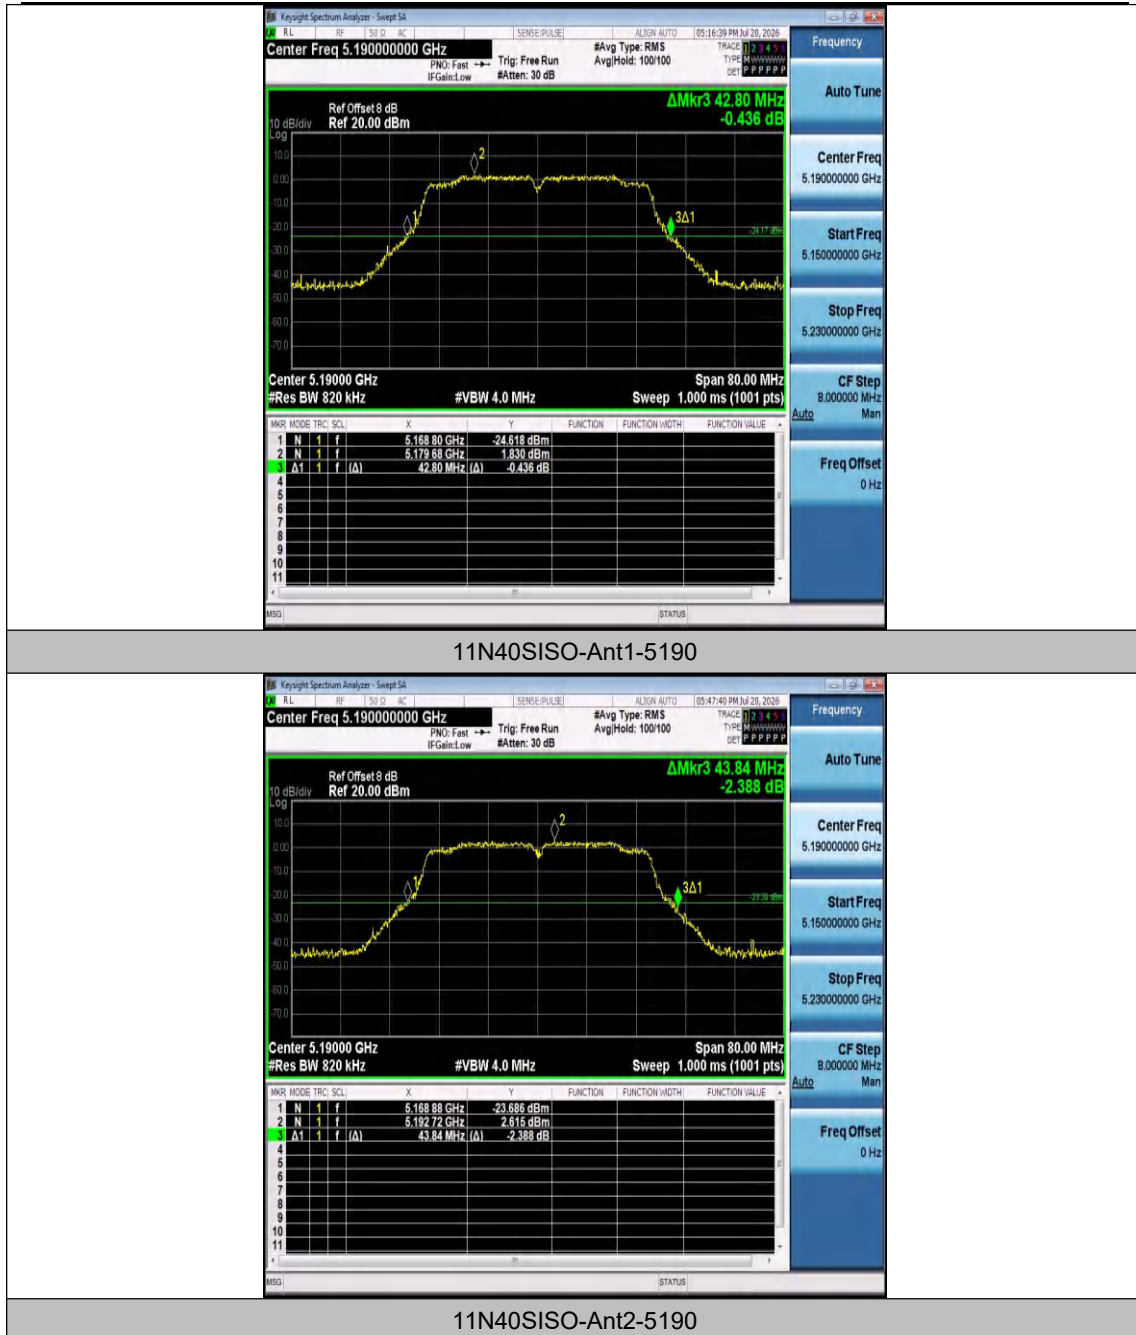

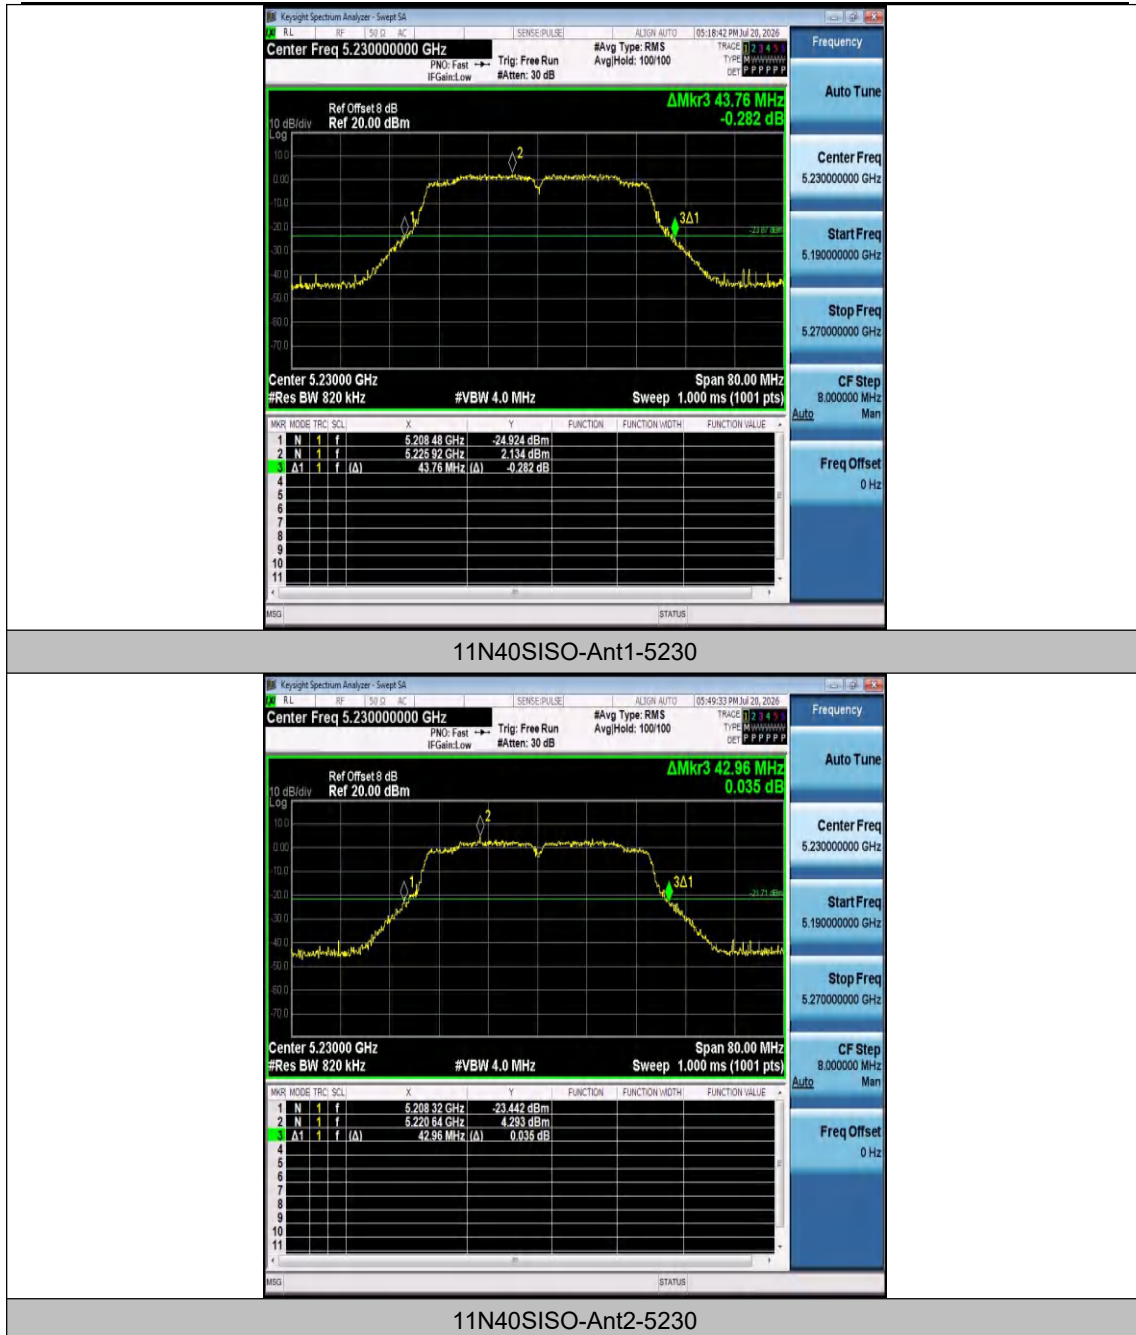

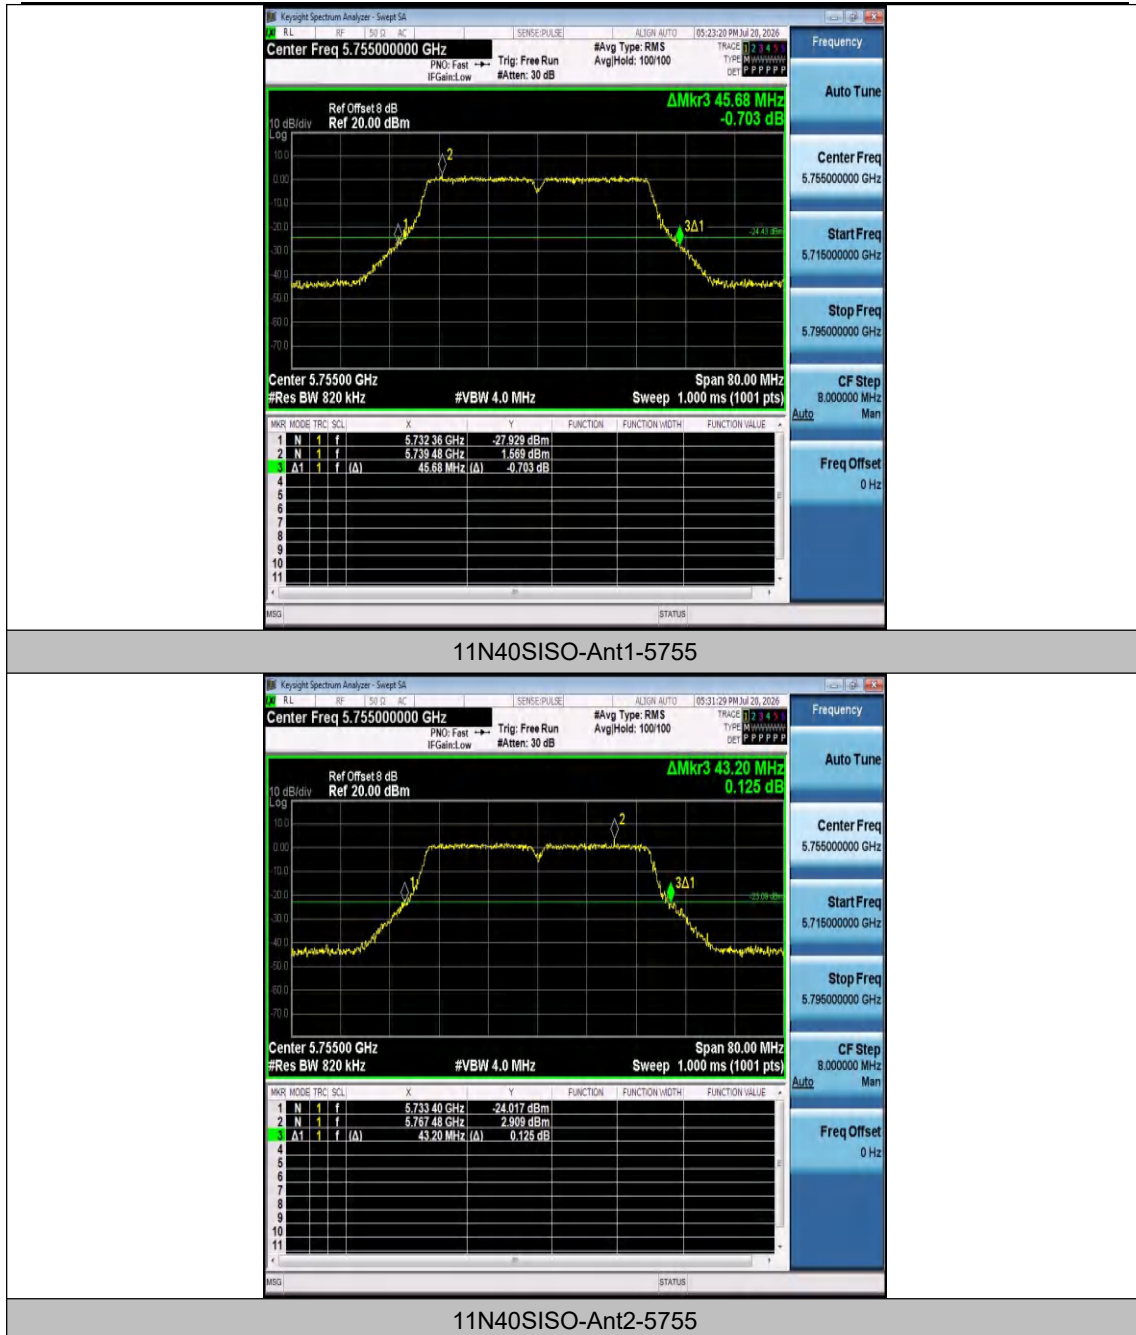

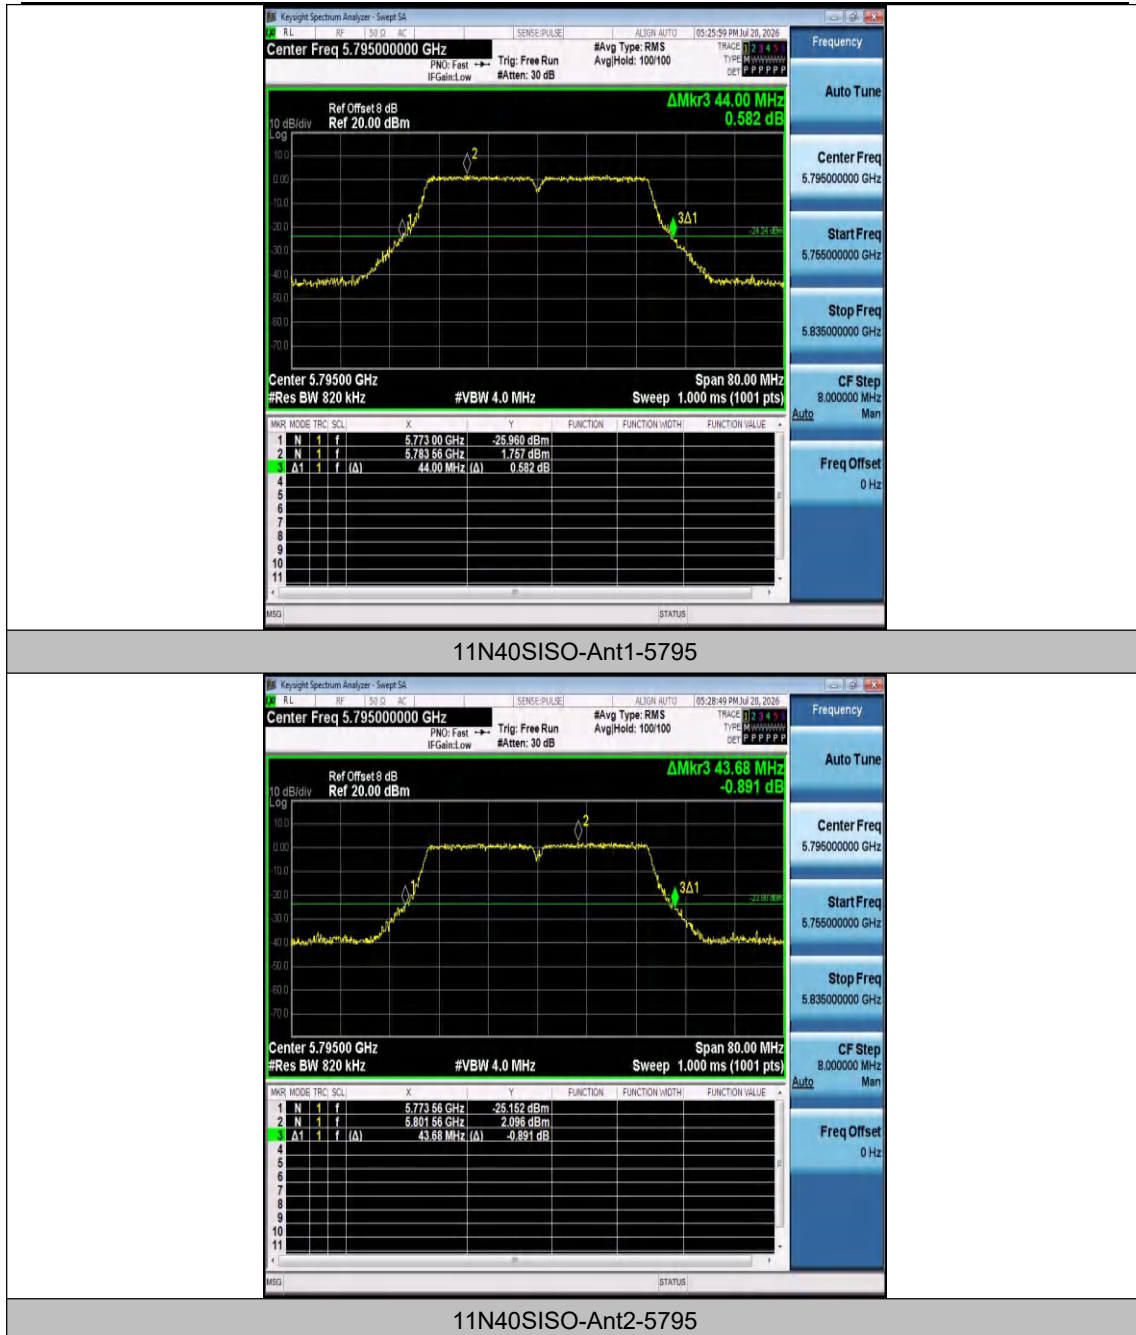



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com







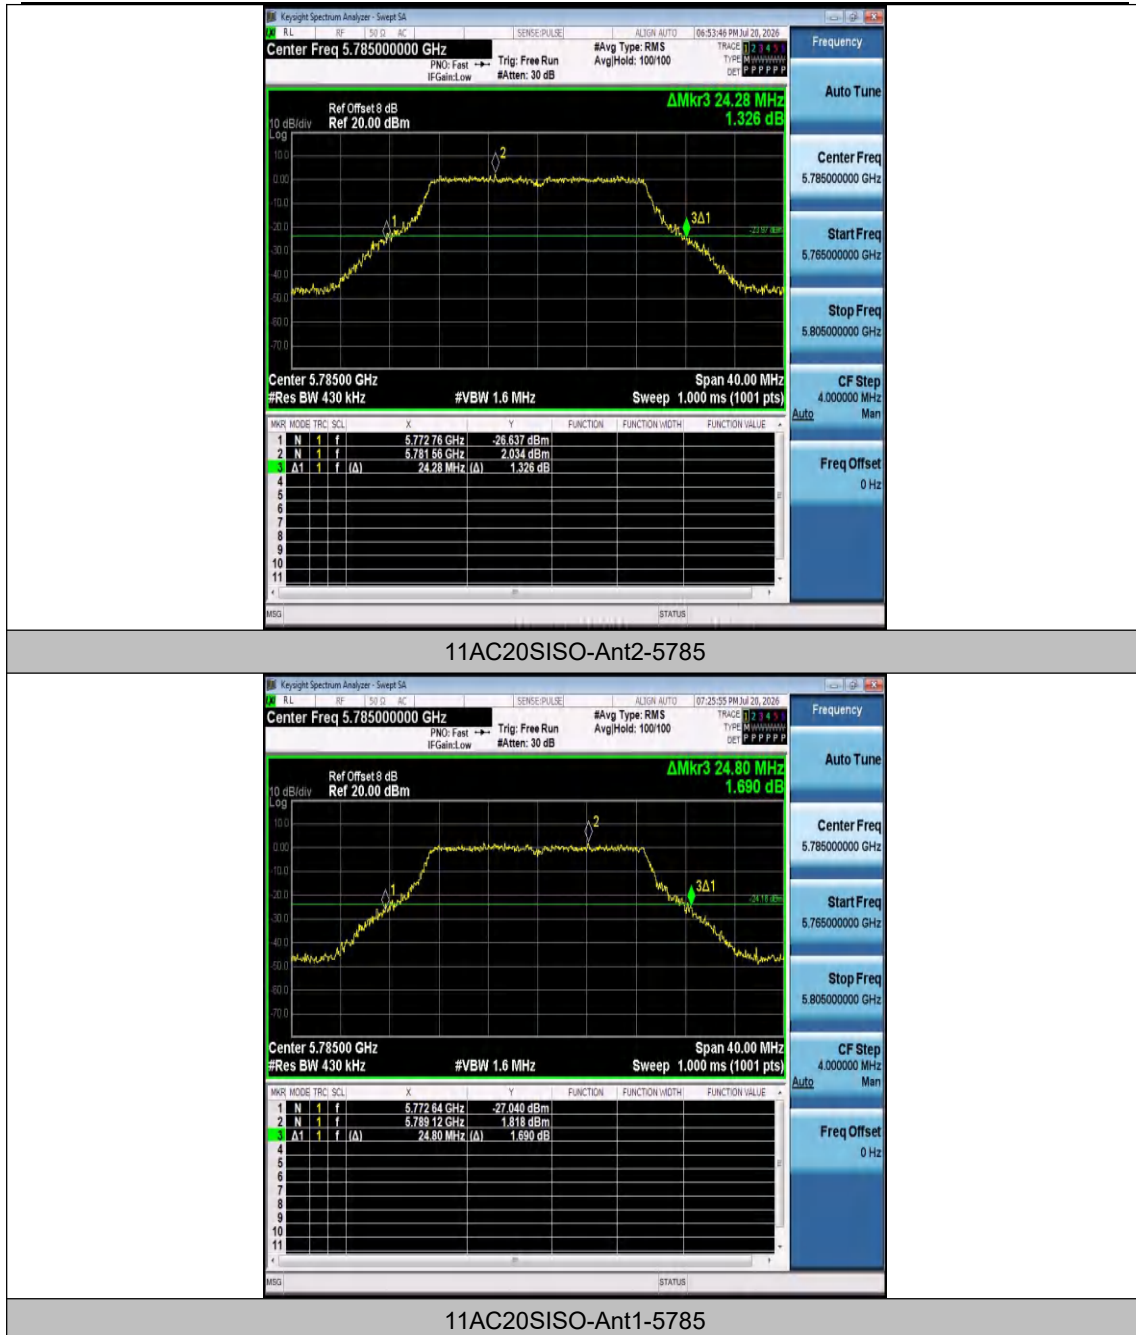




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

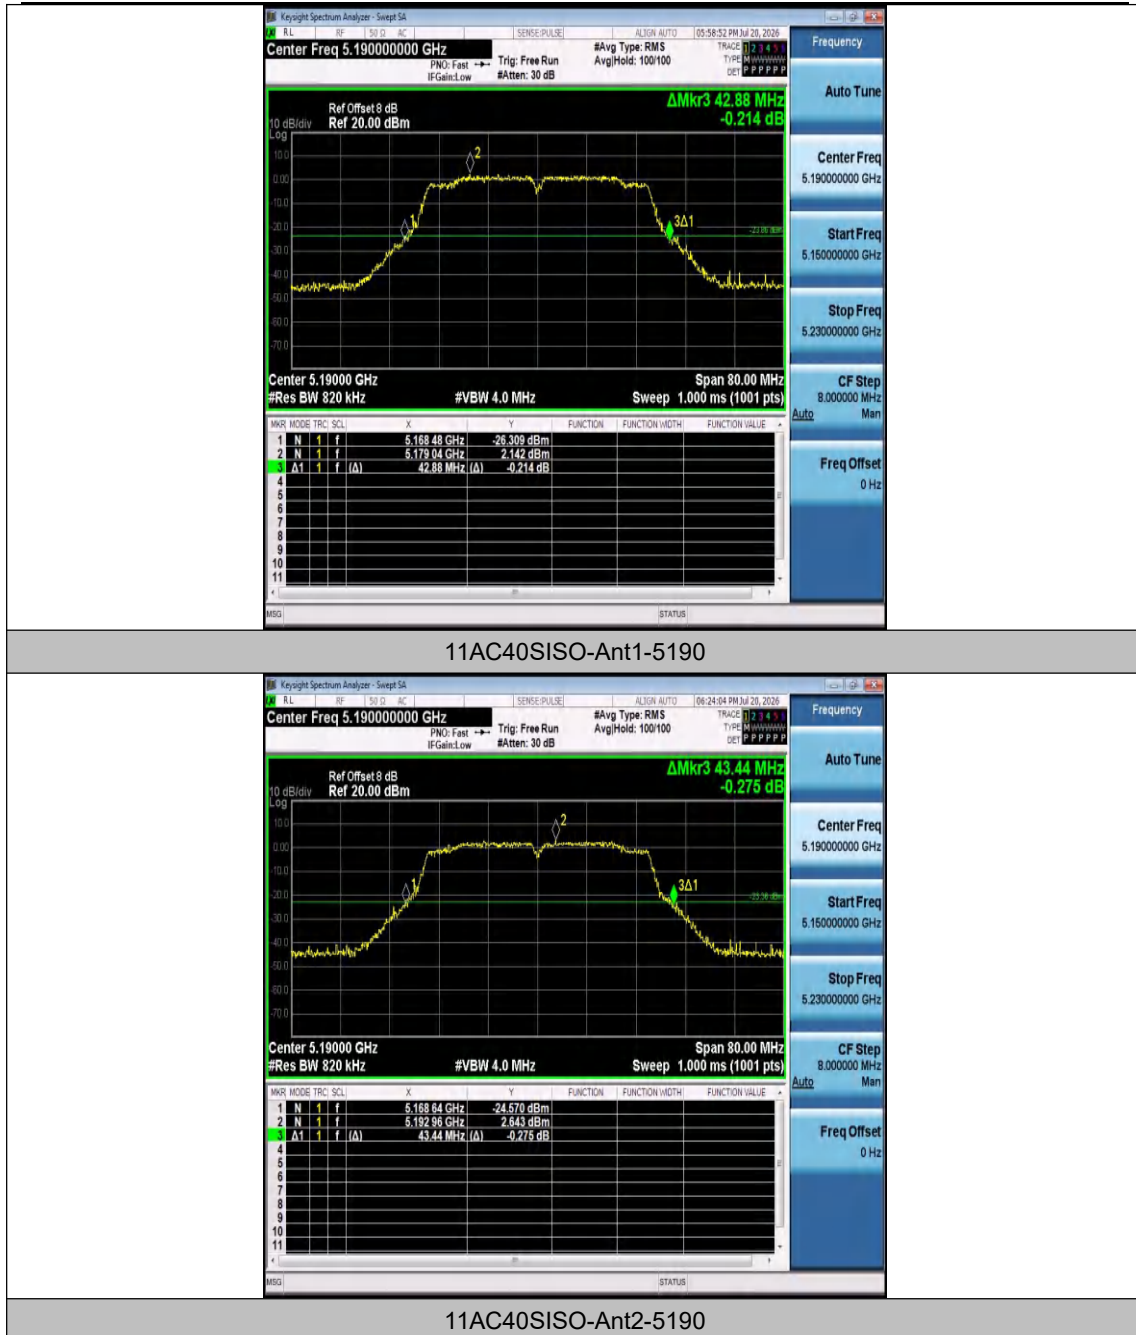



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

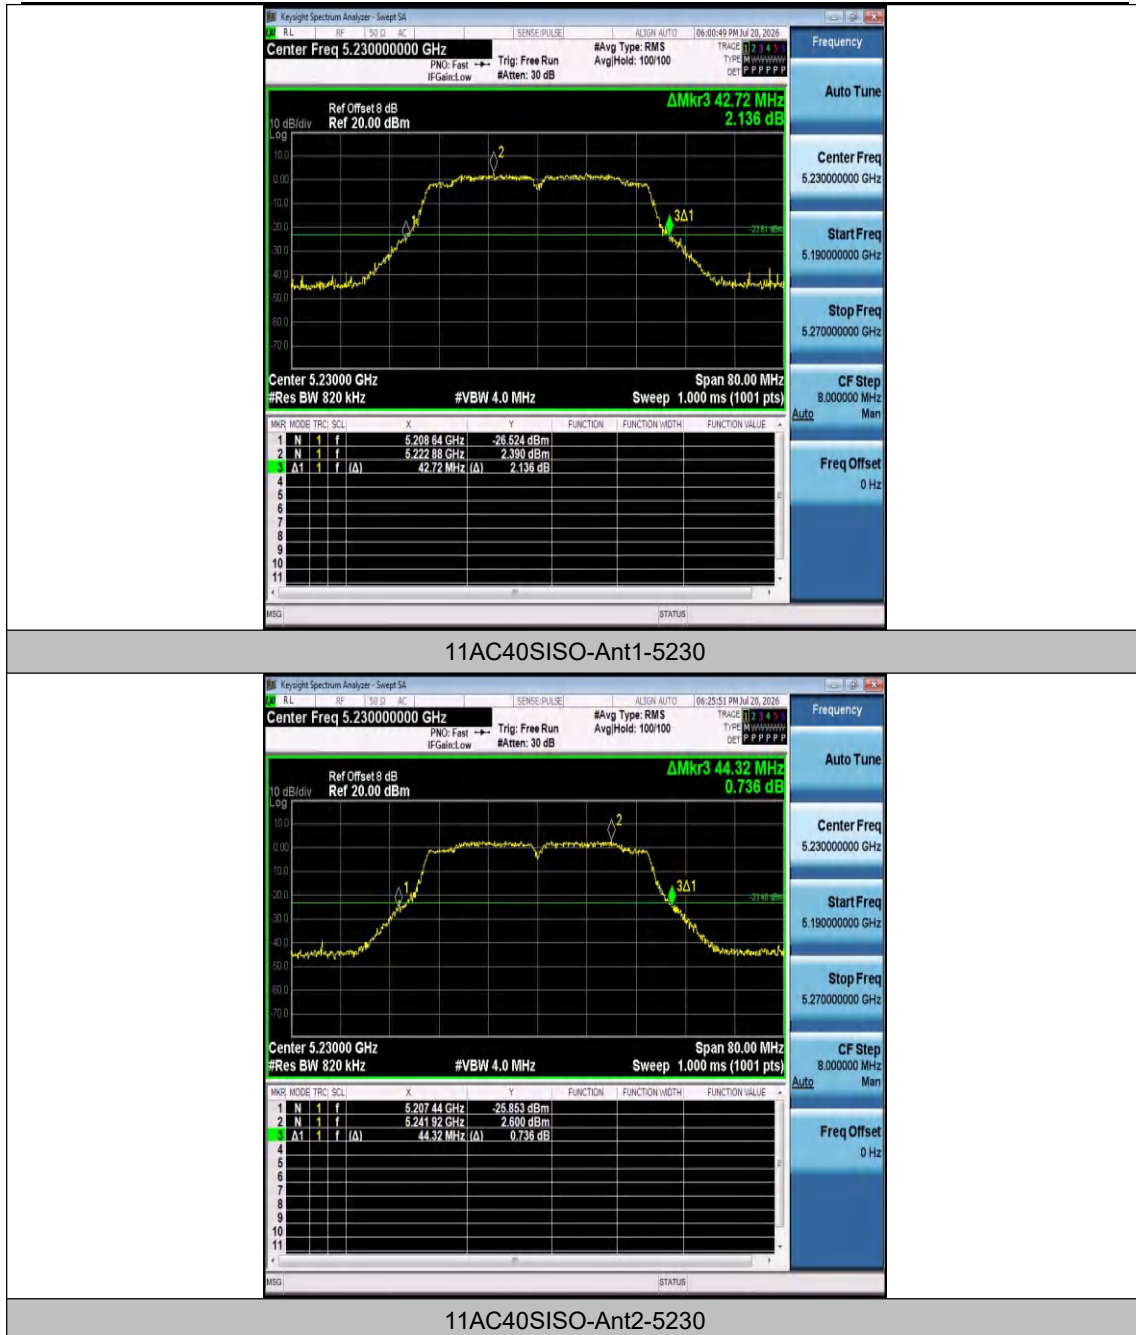

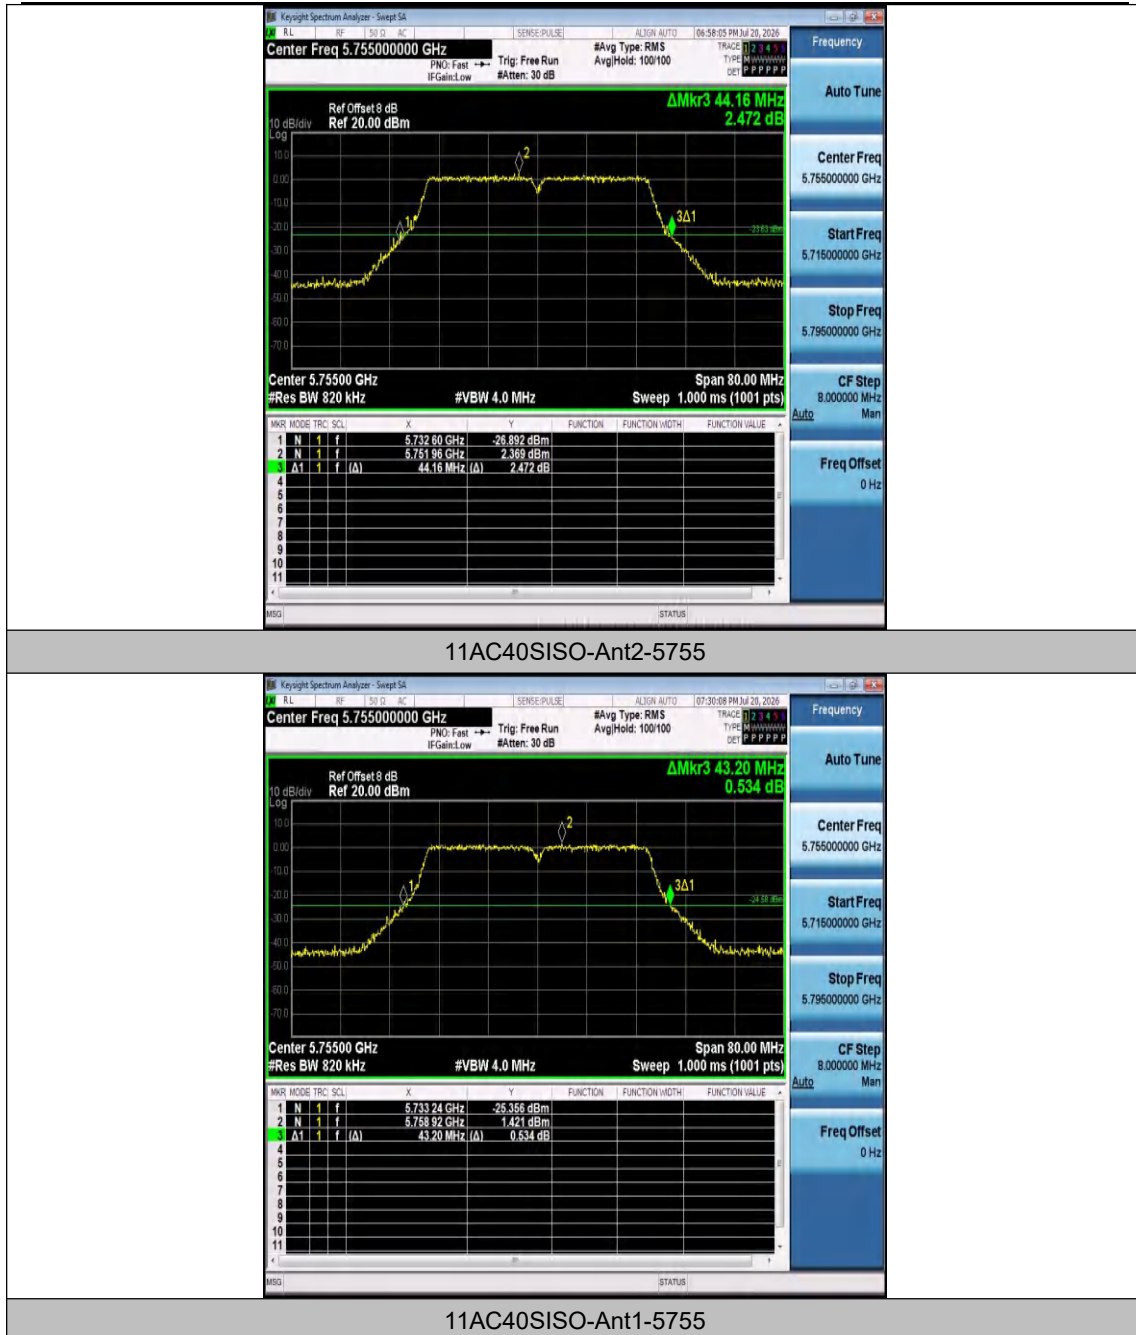


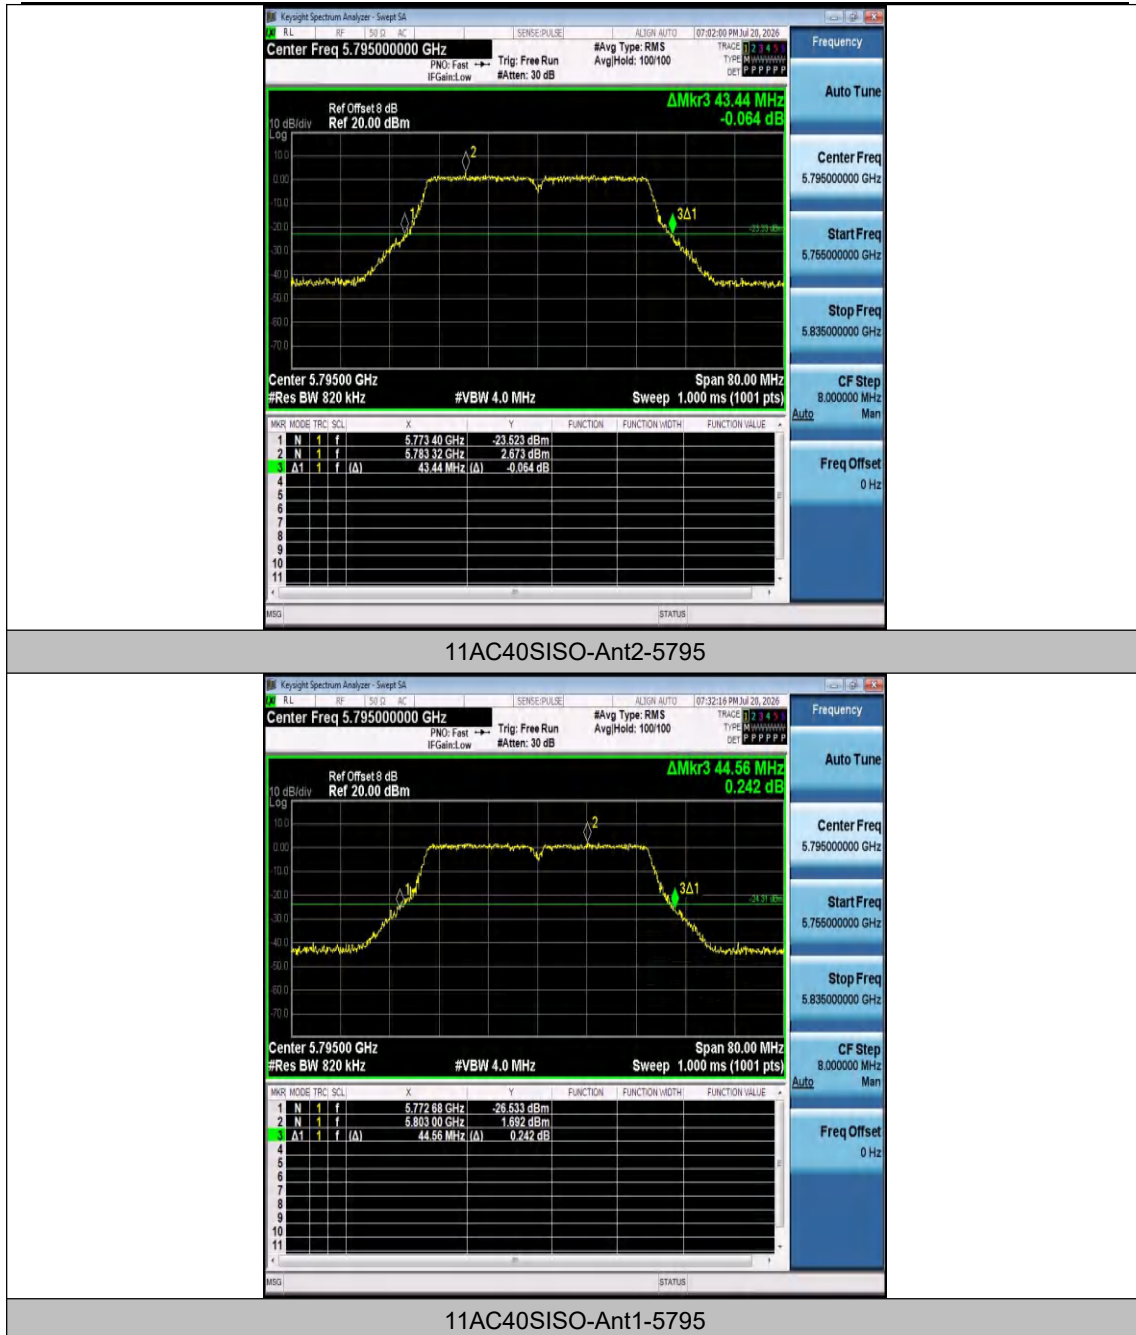



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

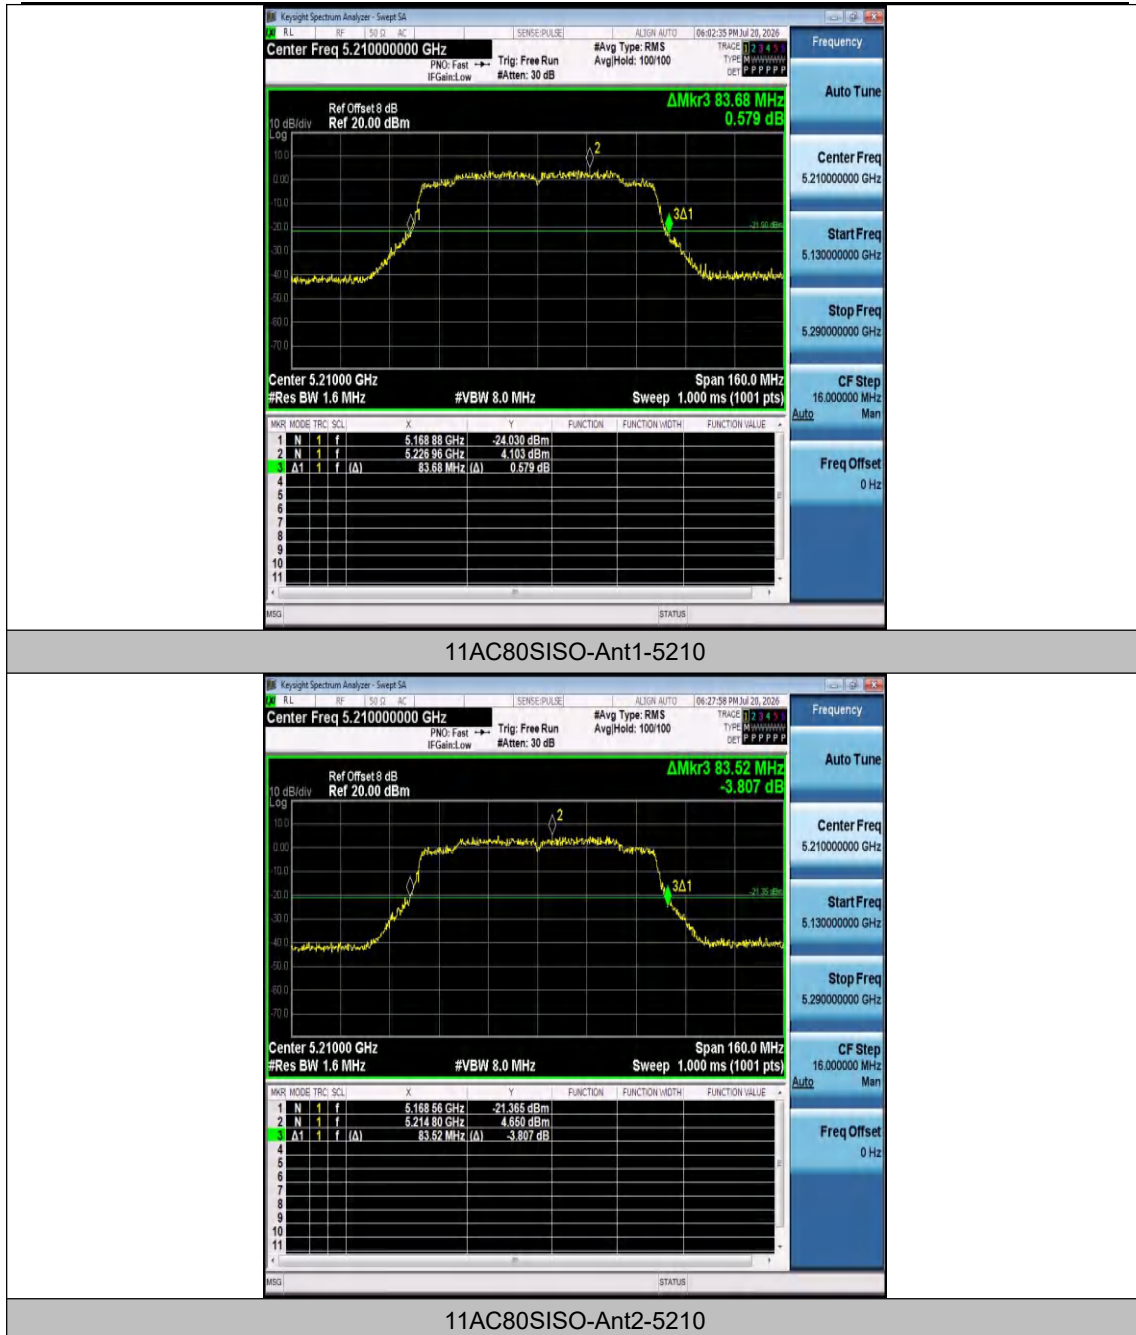

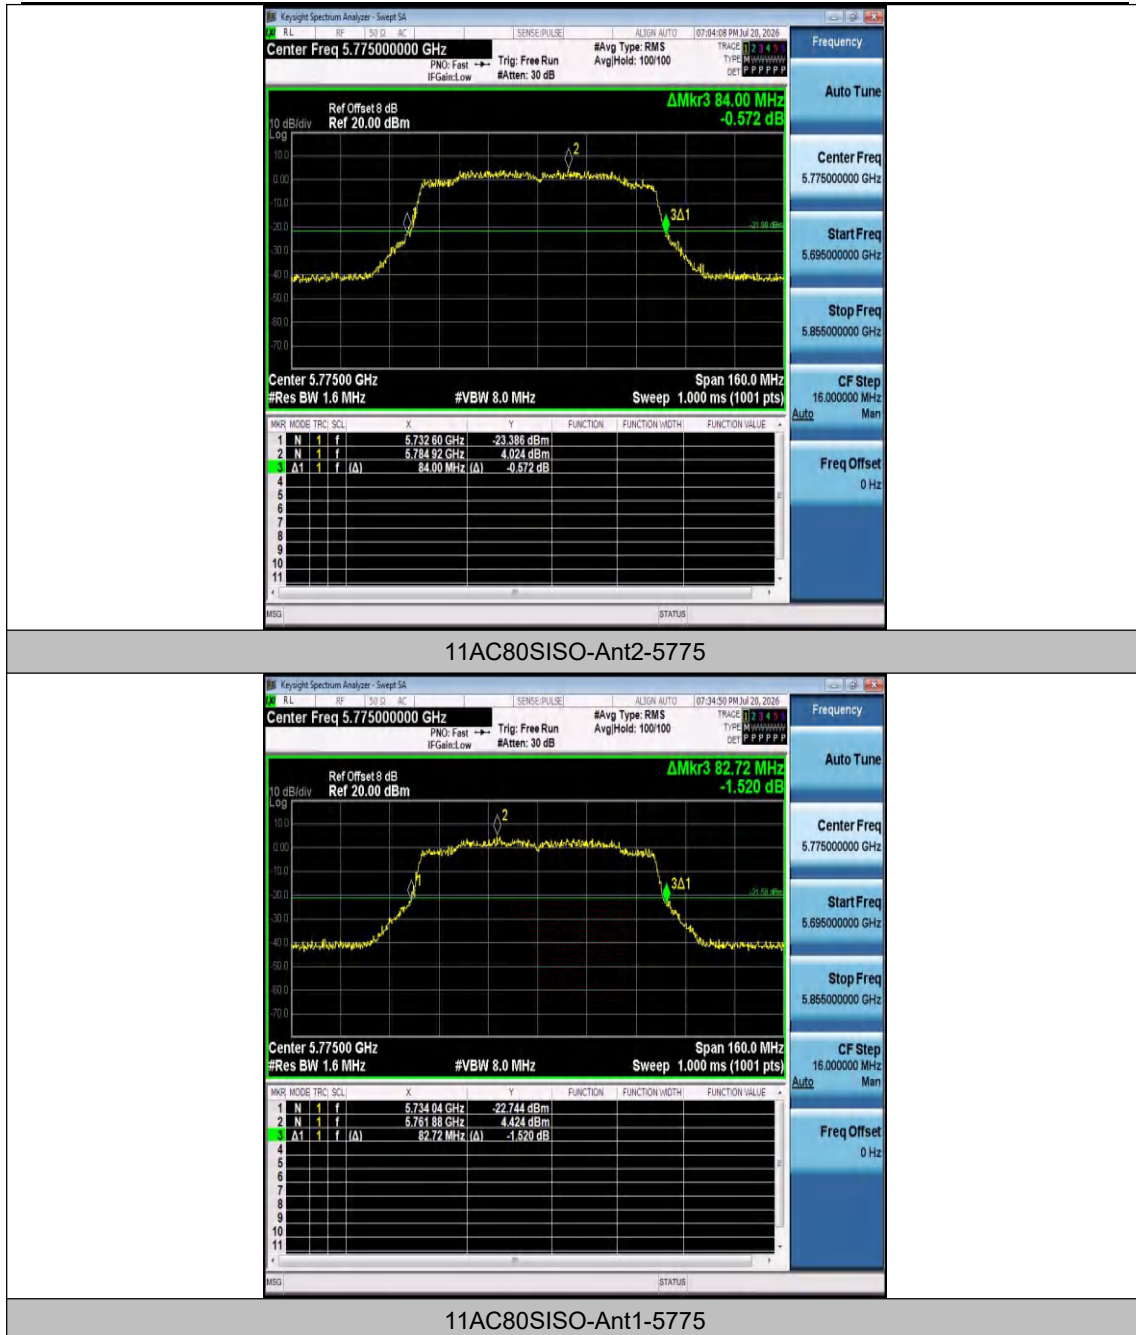

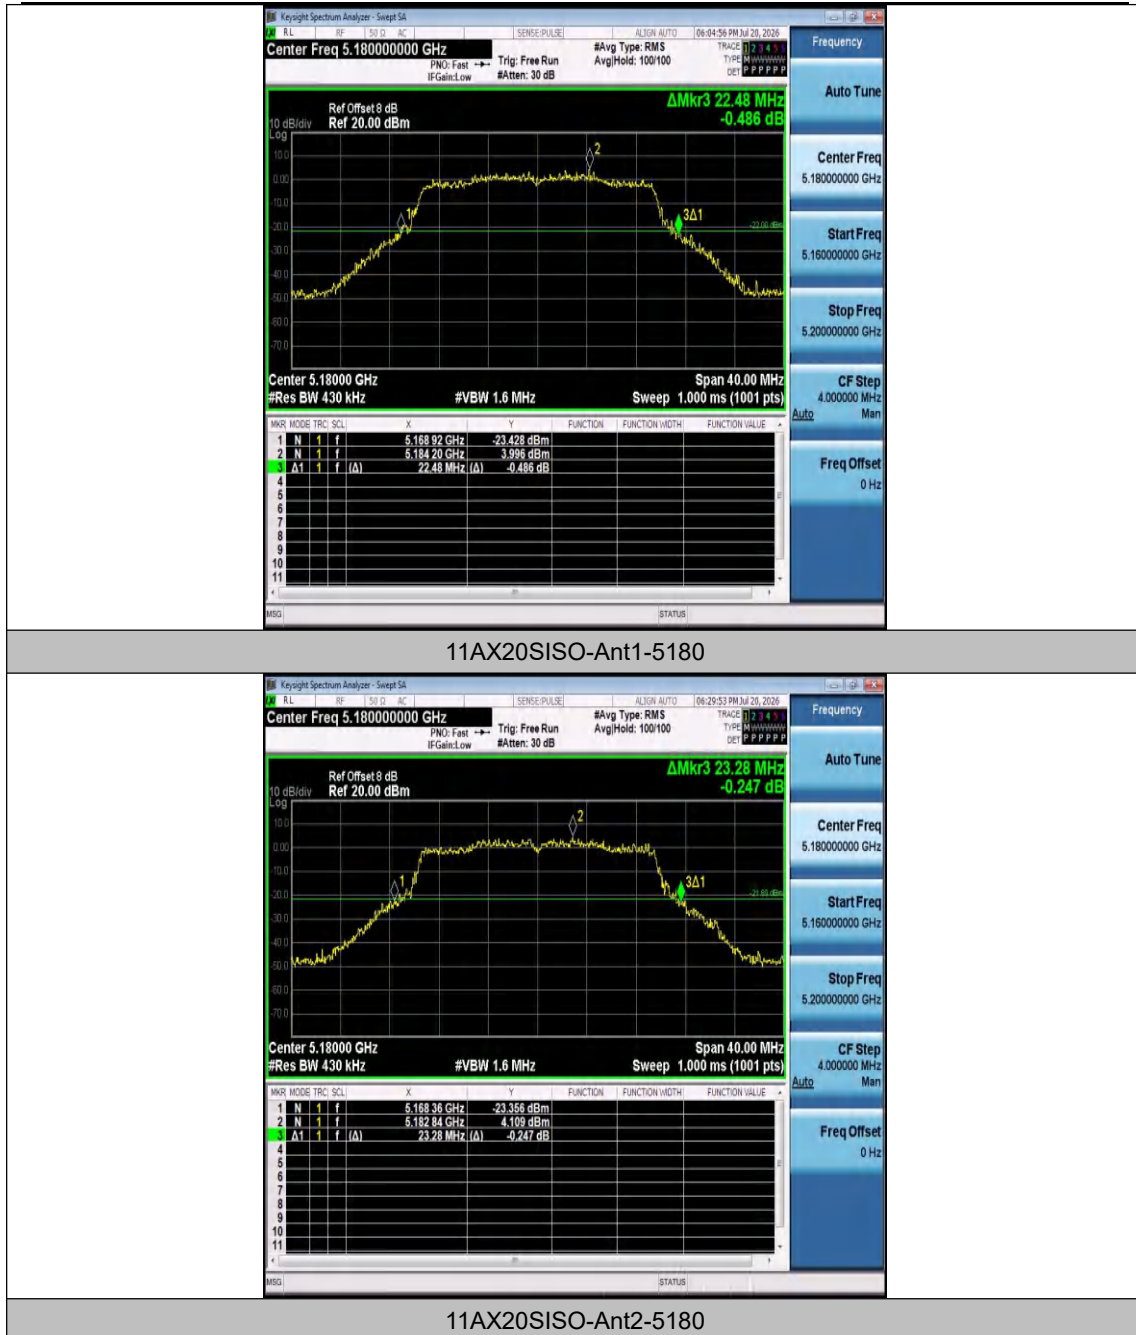


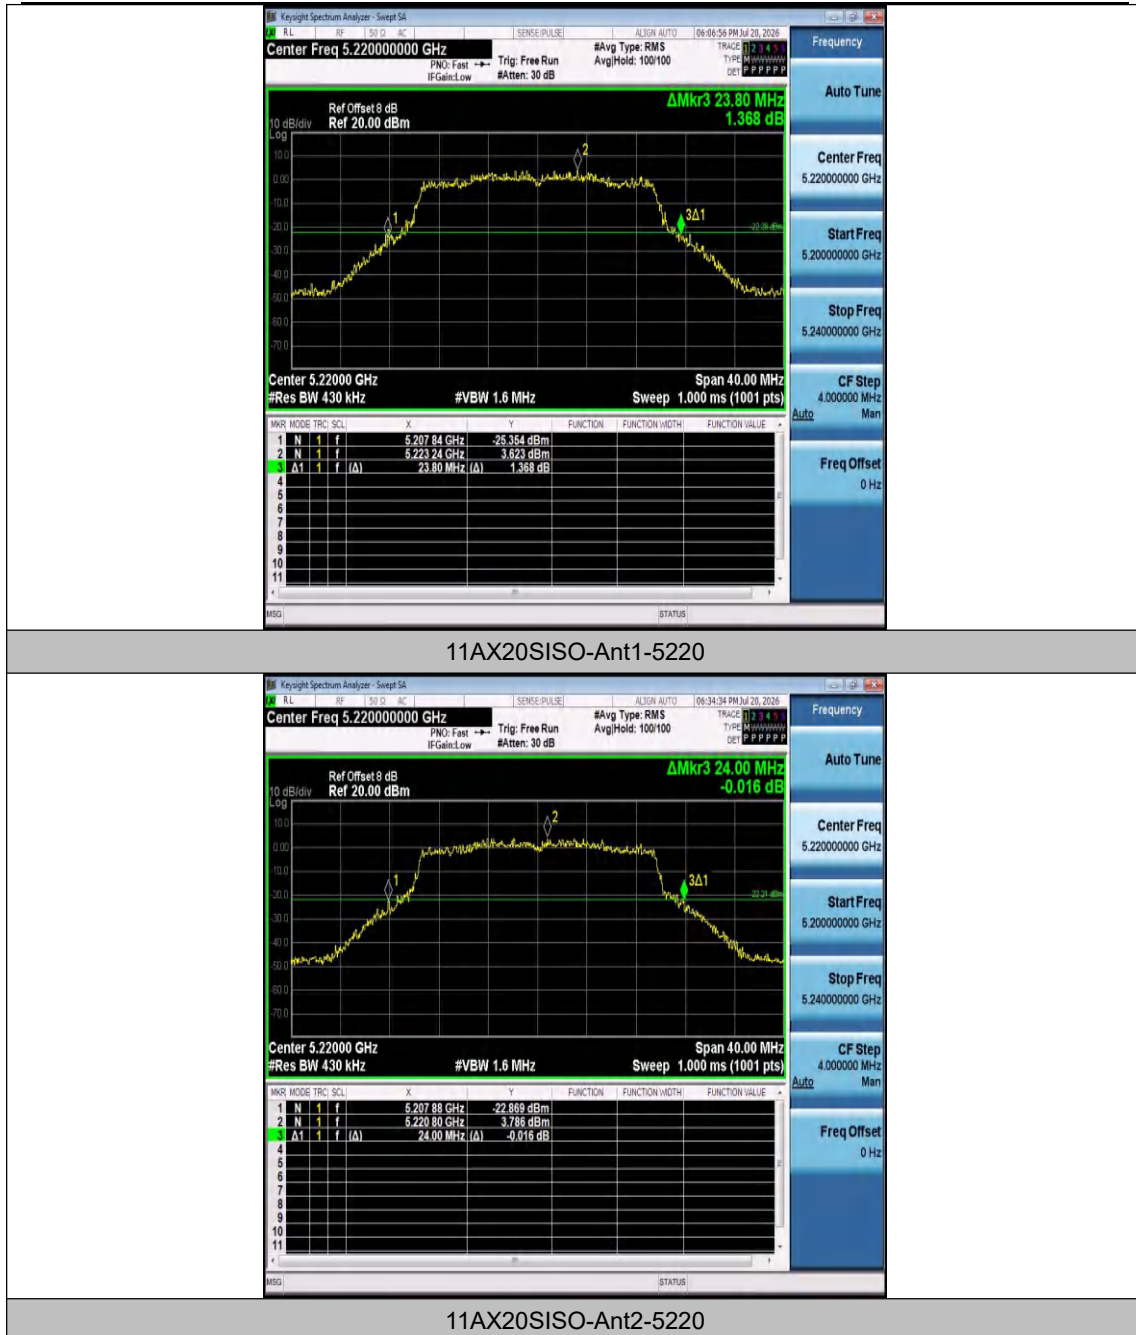

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

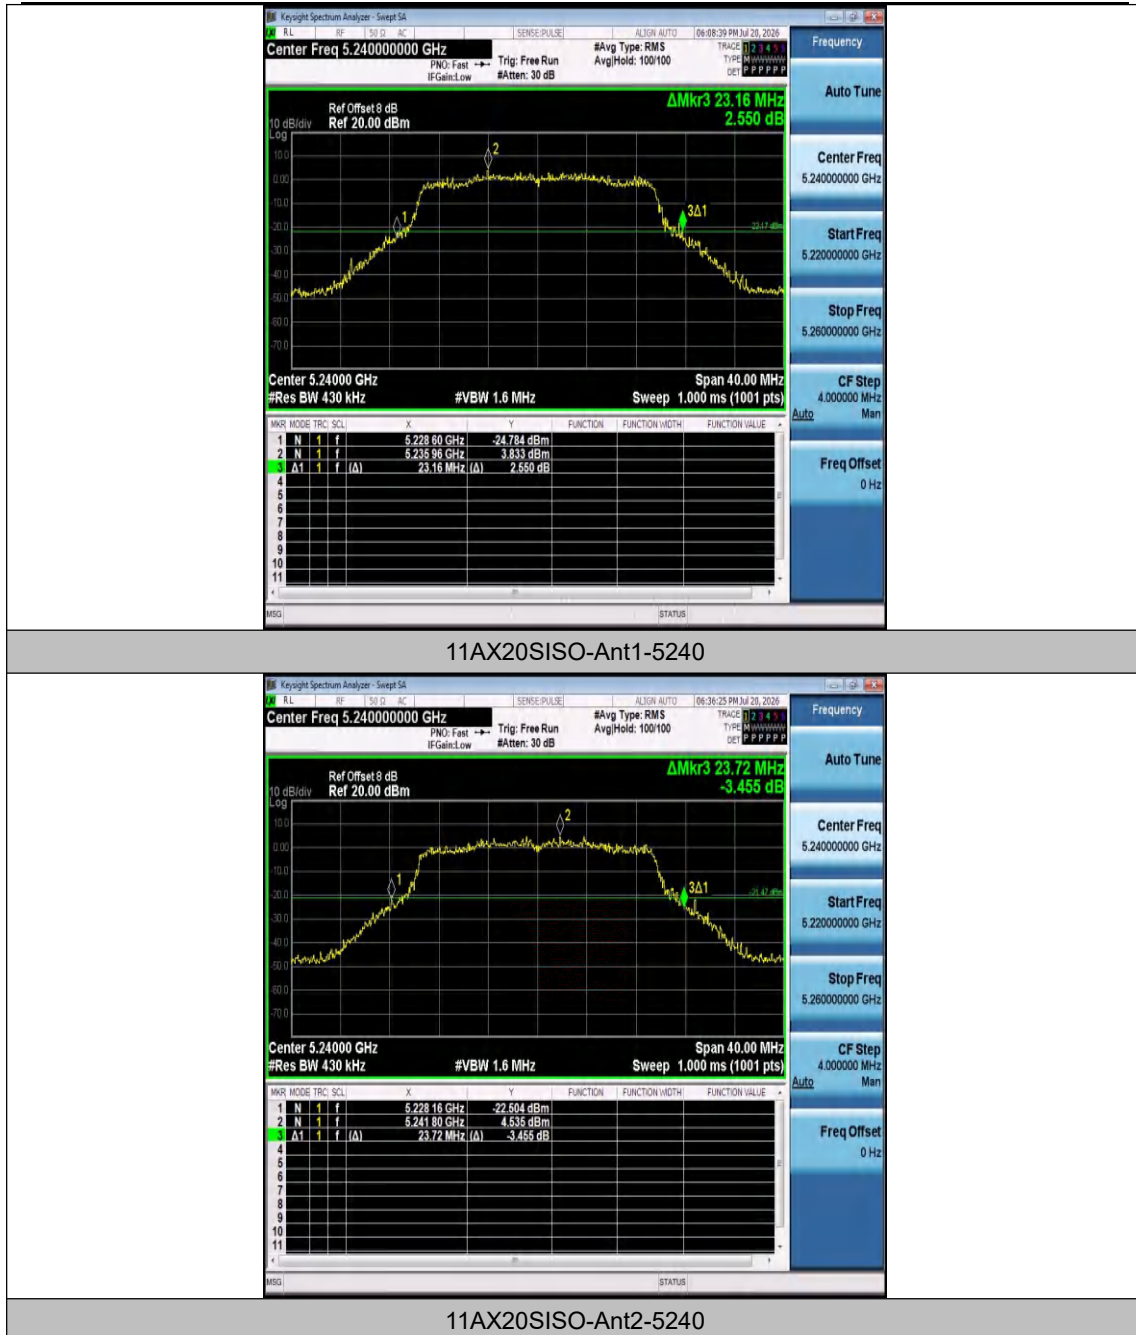



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




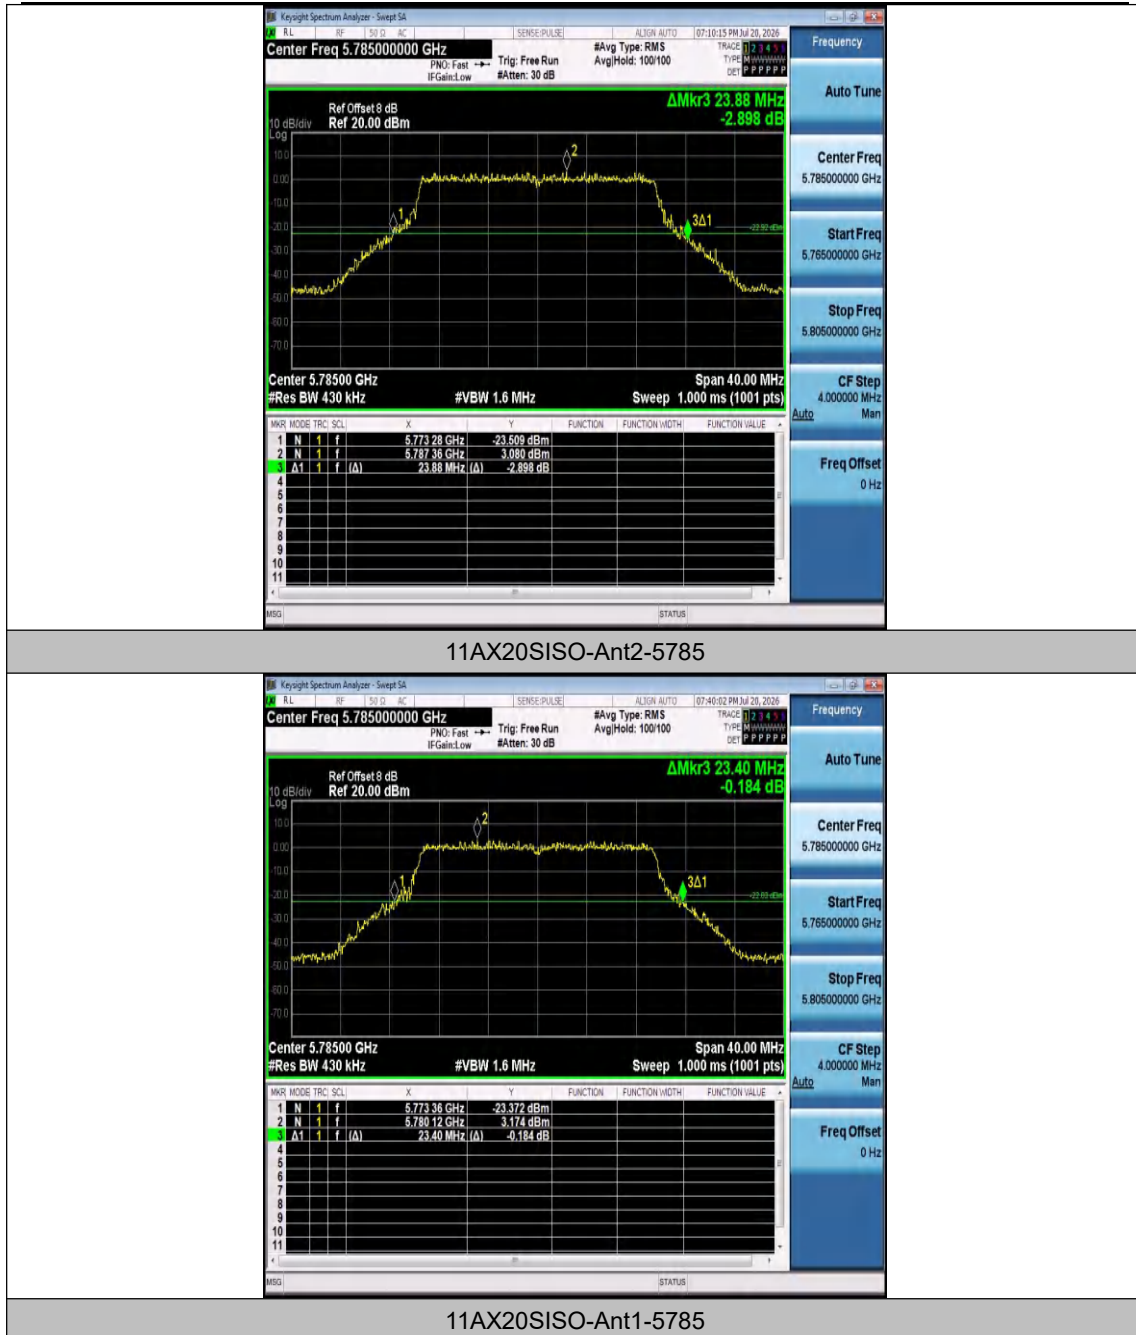


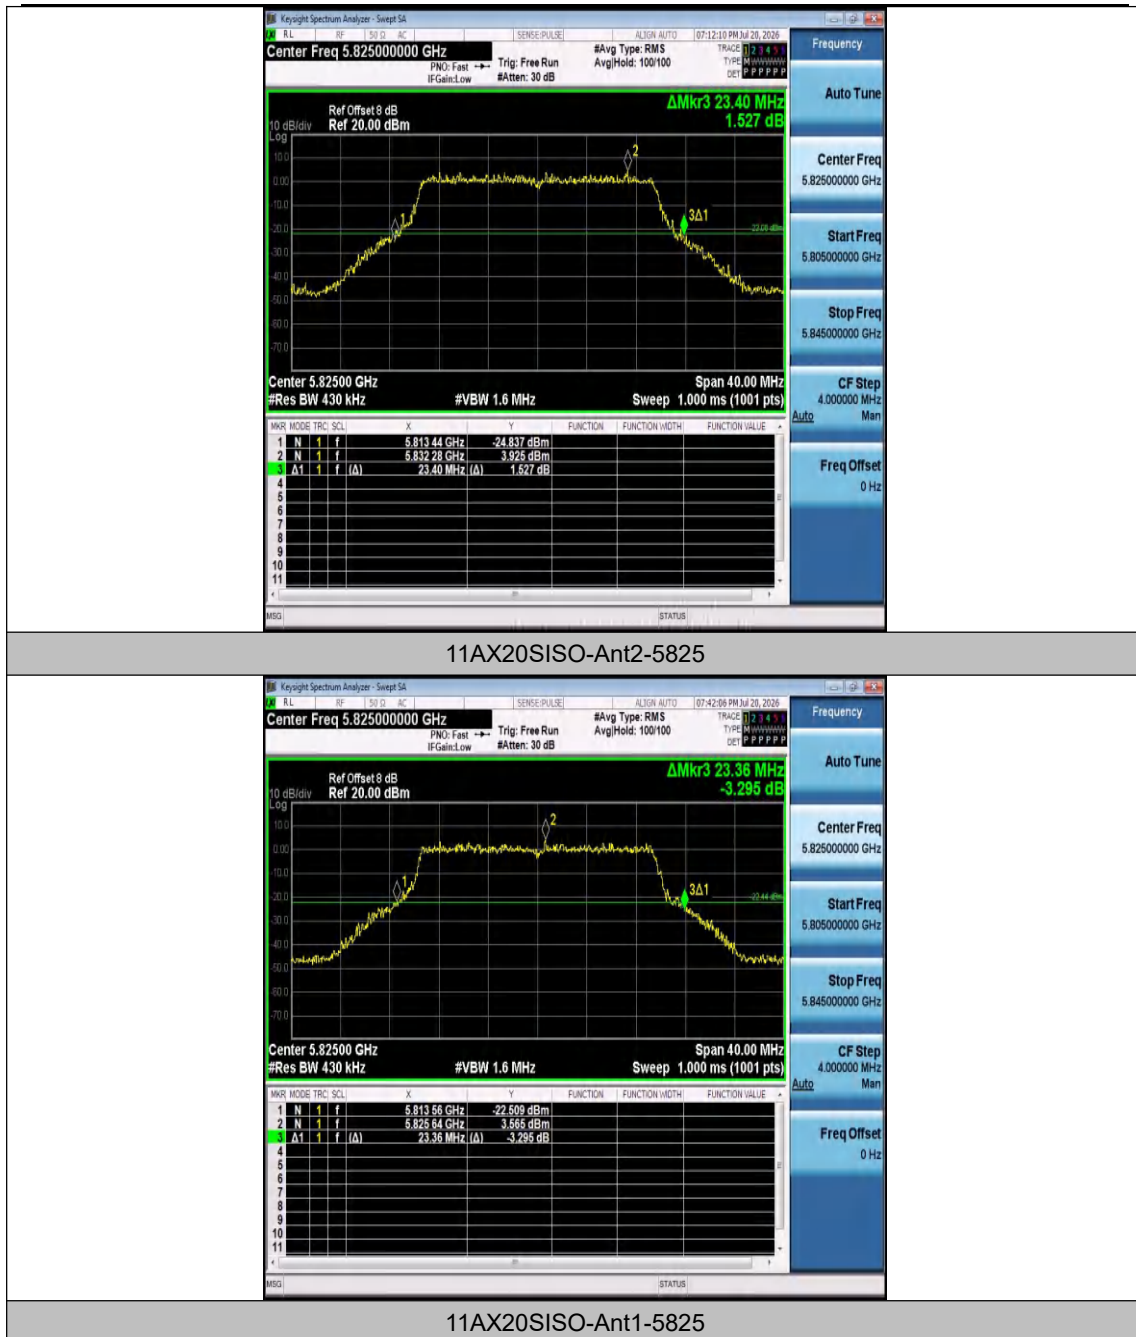


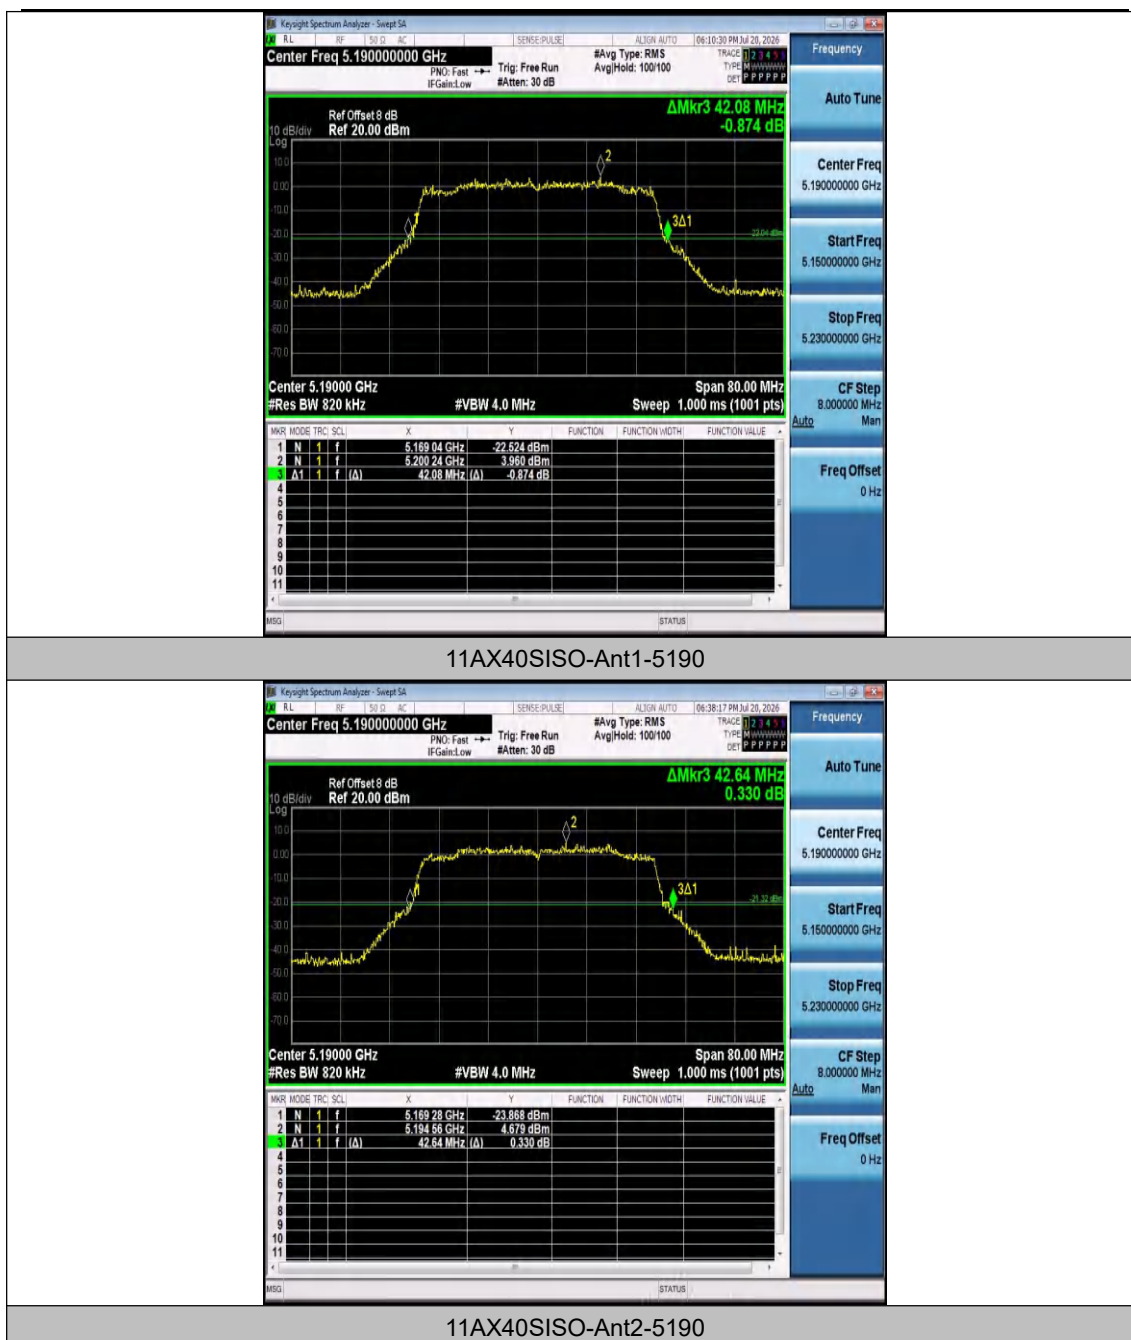


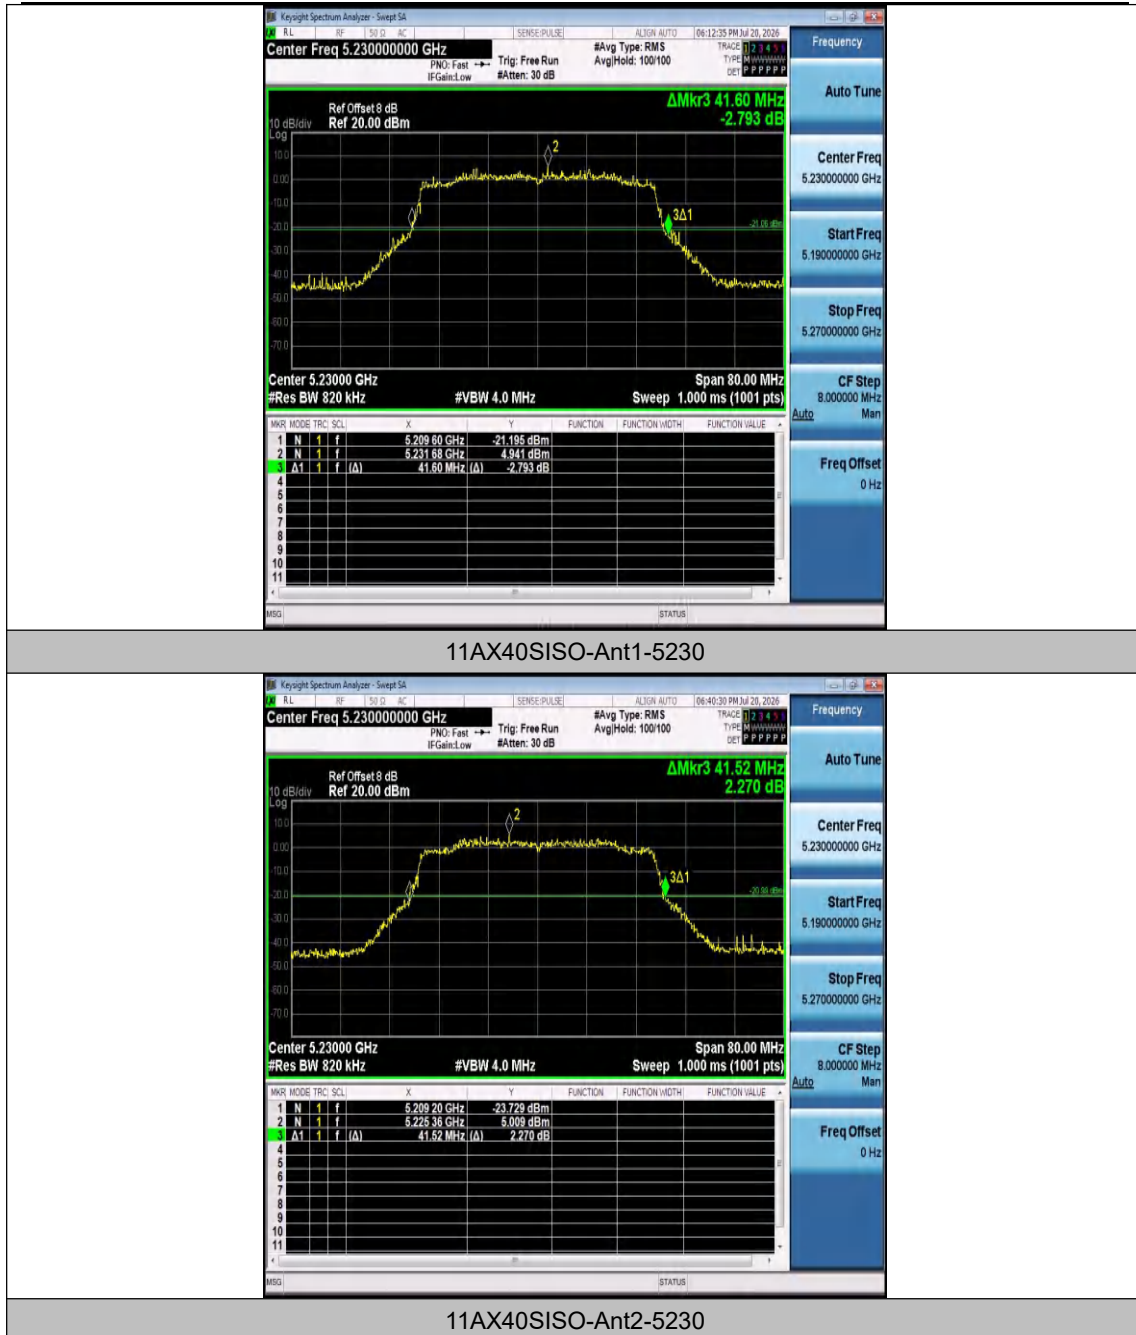

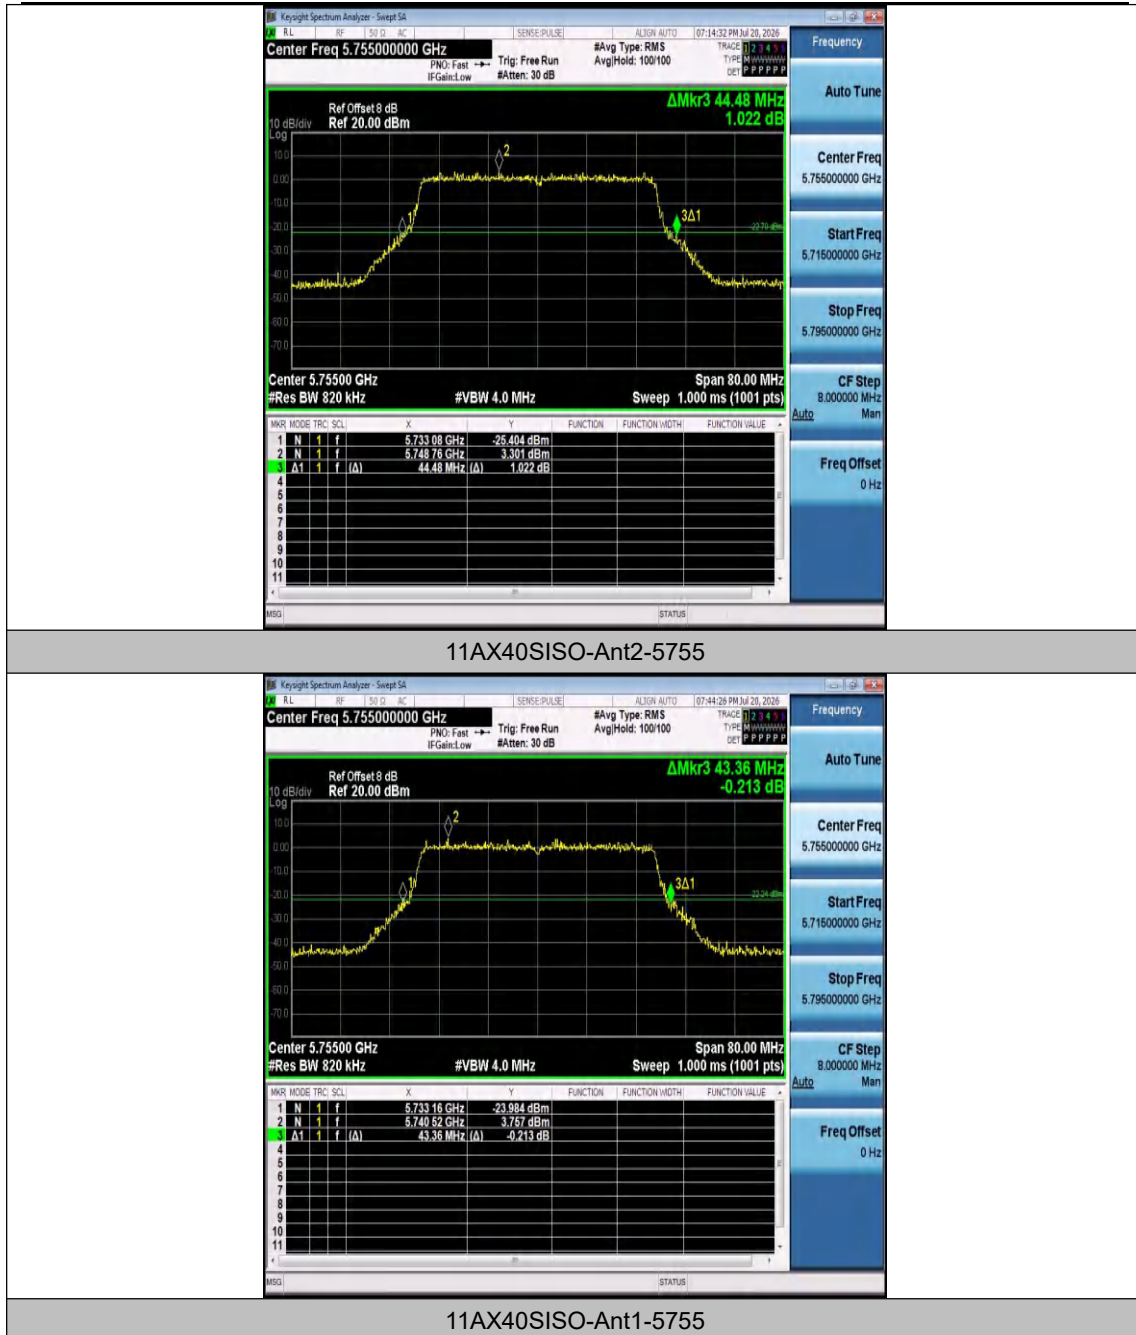

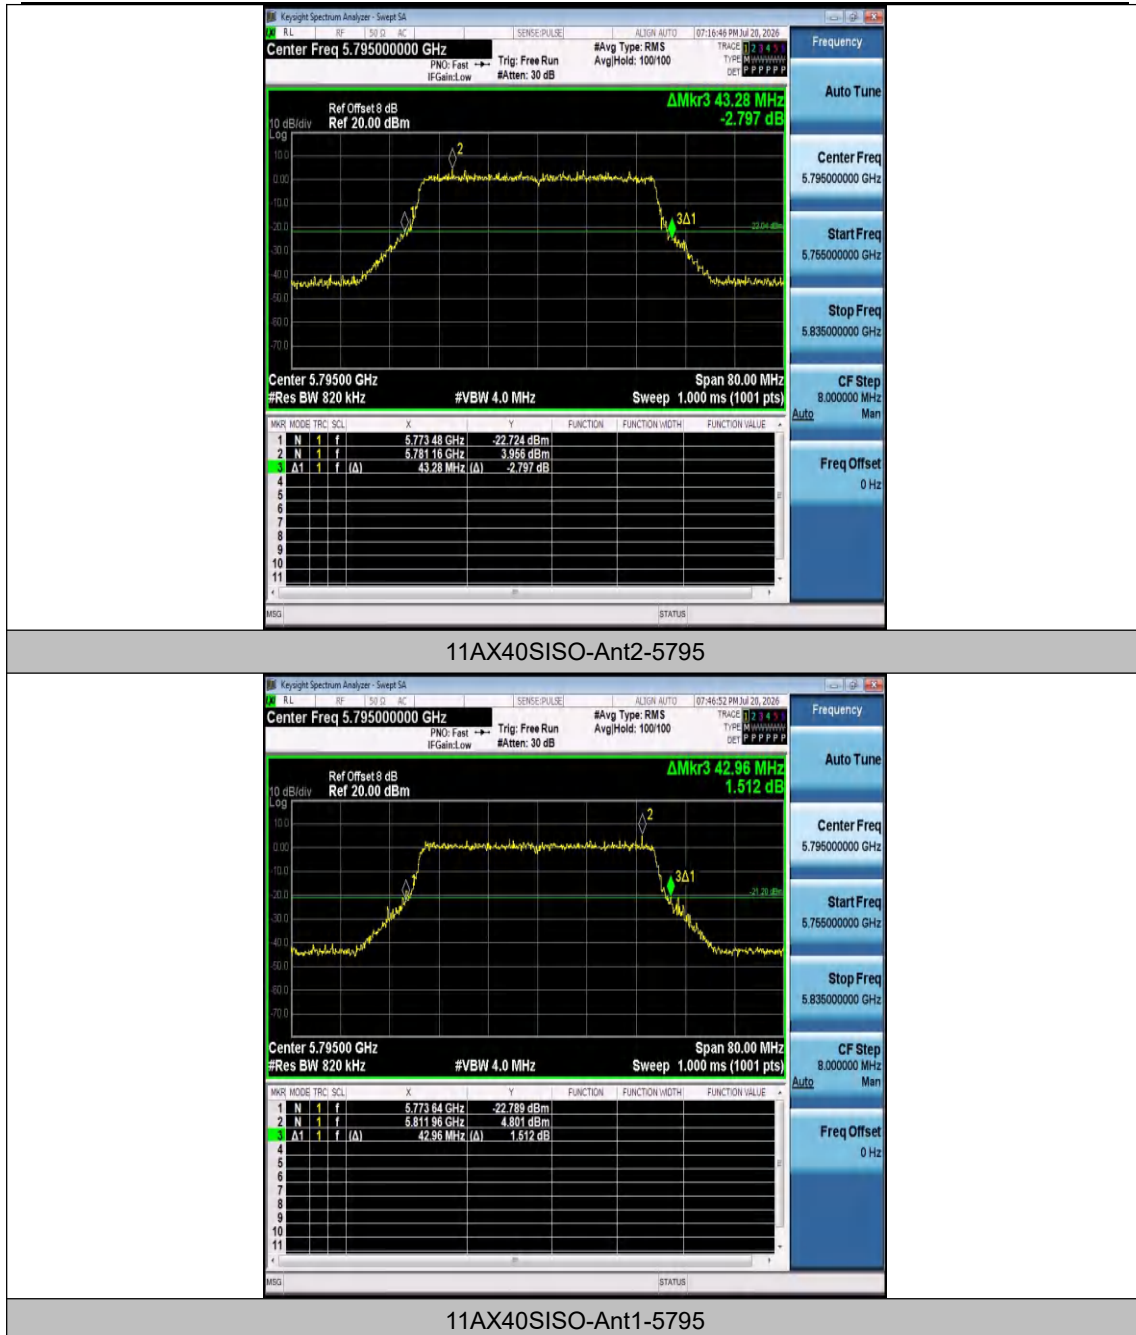

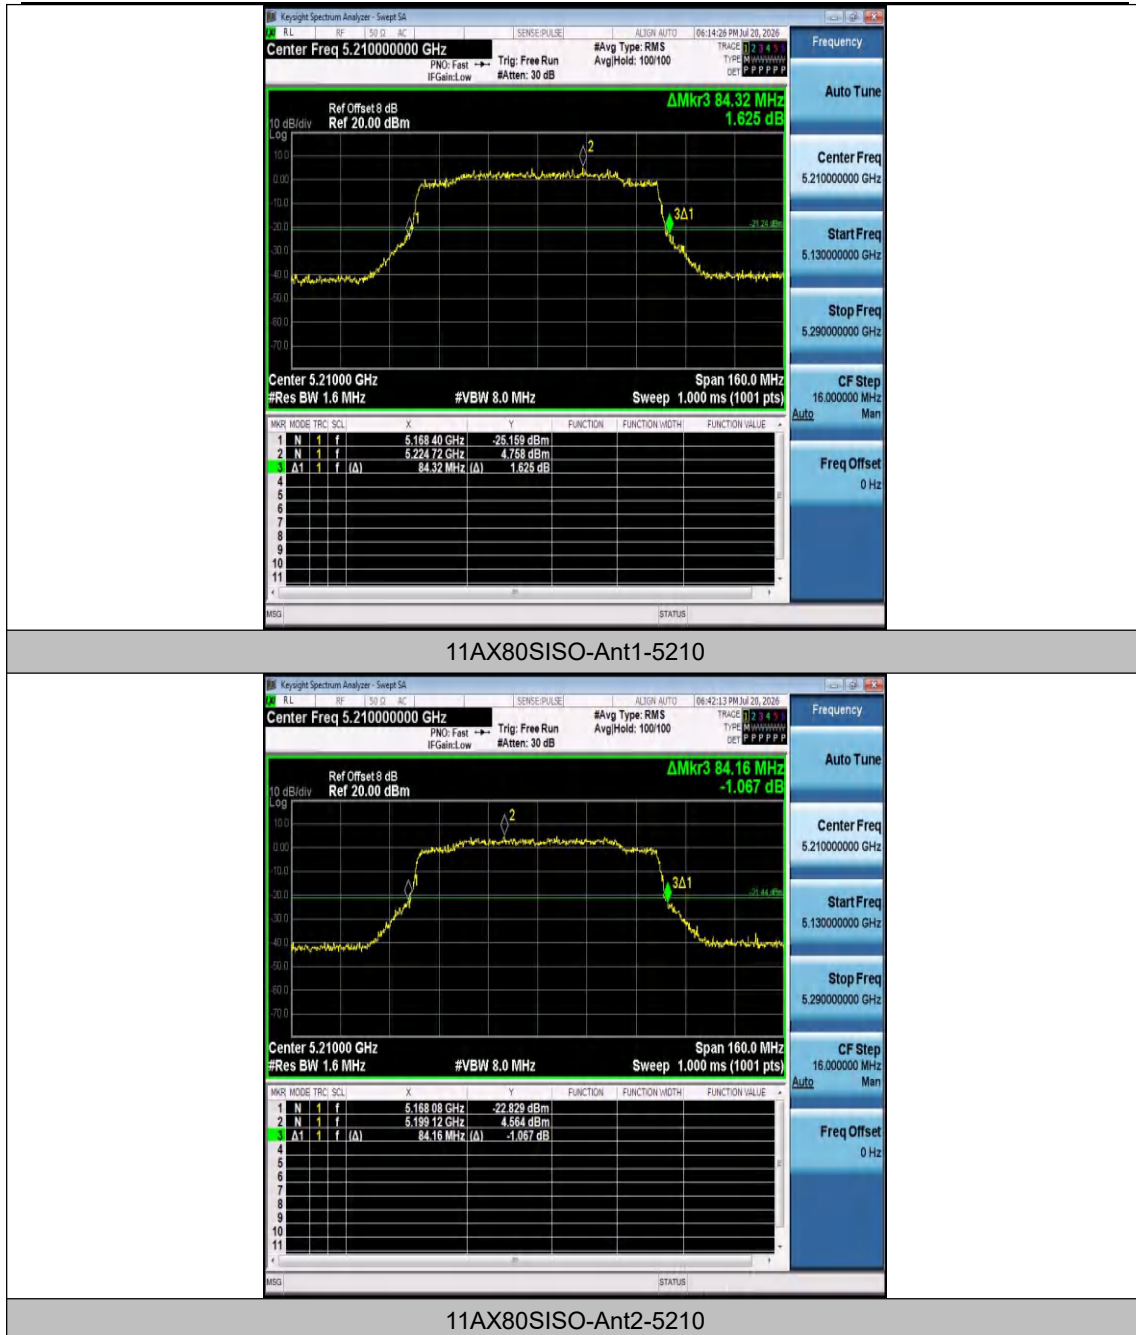

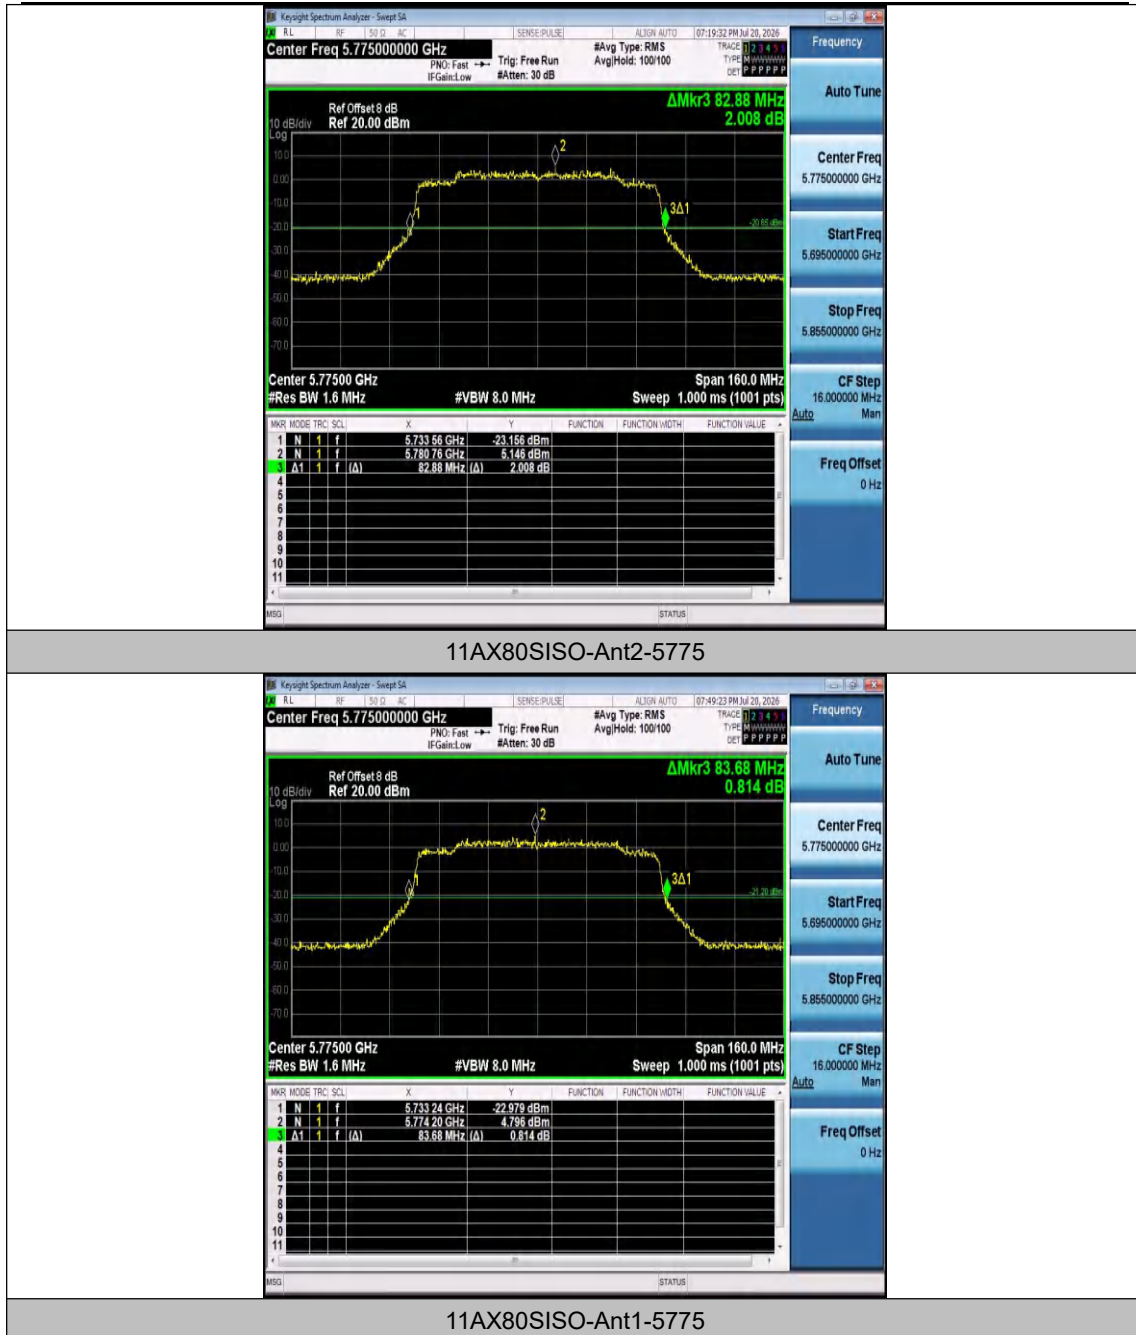

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.937	5171.6265	5188.5635	---	---
11A	Ant2	5180	16.882	5171.6114	5188.4934	---	---
11A	Ant1	5220	16.921	5211.5883	5228.5093	---	---
11A	Ant2	5220	16.905	5211.6054	5228.5104	---	---
11A	Ant1	5240	16.910	5231.5819	5248.4919	---	---
11A	Ant2	5240	16.935	5231.6006	5248.5356	---	---
11A	Ant1	5745	17.198	5736.4789	5753.6769	---	---
11A	Ant2	5745	17.220	5736.4015	5753.6215	---	---
11A	Ant1	5785	17.214	5776.4317	5793.6457	---	---
11A	Ant2	5785	17.184	5776.4089	5793.5929	---	---
11A	Ant1	5825	17.157	5816.4117	5833.5687	---	---
11A	Ant2	5825	17.176	5816.4133	5833.5893	---	---
11N20SISO	Ant1	5180	17.882	5171.1066	5188.9886	---	---
11N20SISO	Ant2	5180	17.943	5171.0720	5189.0150	---	---
11N20SISO	Ant1	5220	17.897	5211.0913	5228.9883	---	---
11N20SISO	Ant2	5220	17.934	5211.1151	5229.0491	---	---
11N20SISO	Ant1	5240	17.966	5231.0830	5249.0490	---	---
11N20SISO	Ant2	5240	17.956	5231.0712	5249.0272	---	---
11N20SISO	Ant1	5745	18.295	5735.9016	5754.1966	---	---
11N20SISO	Ant2	5745	18.307	5735.8627	5754.1697	---	---
11N20SISO	Ant1	5785	18.257	5775.8792	5794.1362	---	---
11N20SISO	Ant2	5785	18.226	5775.8997	5794.1257	---	---
11N20SISO	Ant1	5825	18.225	5815.9032	5834.1282	---	---
11N20SISO	Ant2	5825	18.303	5815.8763	5834.1793	---	---
11N40SISO	Ant1	5190	36.086	5172.0615	5208.1475	---	---
11N40SISO	Ant2	5190	36.133	5172.0464	5208.1794	---	---
11N40SISO	Ant1	5230	36.086	5212.0265	5248.1125	---	---
11N40SISO	Ant2	5230	36.138	5212.0216	5248.1596	---	---
11N40SISO	Ant1	5755	36.589	5736.8335	5773.4225	---	---
11N40SISO	Ant2	5755	36.663	5736.7207	5773.3837	---	---
11N40SISO	Ant1	5795	36.641	5776.7303	5813.3713	---	---
11N40SISO	Ant2	5795	36.537	5776.7921	5813.3291	---	---
11AC20SISO	Ant1	5180	17.938	5171.1129	5189.0509	---	---
11AC20SISO	Ant2	5180	17.923	5171.1011	5189.0241	---	---
11AC20SISO	Ant1	5220	17.923	5211.0889	5229.0119	---	---
11AC20SISO	Ant2	5220	17.954	5211.0742	5229.0282	---	---
11AC20SISO	Ant1	5240	17.926	5231.1035	5249.0295	---	---
11AC20SISO	Ant2	5240	17.894	5231.0846	5248.9786	---	---


11AC20SISO	Ant2	5745	18.287	5735.9461	5754.2331	---	---
11AC20SISO	Ant1	5745	18.279	5735.9078	5754.1868	---	---
11AC20SISO	Ant2	5785	18.293	5775.8610	5794.1540	---	---
11AC20SISO	Ant1	5785	18.283	5775.8826	5794.1656	---	---
11AC20SISO	Ant2	5825	18.193	5815.8974	5834.0904	---	---
11AC20SISO	Ant1	5825	18.331	5815.8652	5834.1962	---	---
11AC40SISO	Ant1	5190	36.145	5171.9985	5208.1435	---	---
11AC40SISO	Ant2	5190	36.068	5172.0516	5208.1196	---	---
11AC40SISO	Ant1	5230	36.085	5212.0270	5248.1120	---	---
11AC40SISO	Ant2	5230	36.099	5212.0396	5248.1386	---	---
11AC40SISO	Ant2	5755	36.665	5736.7465	5773.4115	---	---
11AC40SISO	Ant1	5755	36.580	5736.7903	5773.3703	---	---
11AC40SISO	Ant2	5795	36.668	5776.7745	5813.4425	---	---
11AC40SISO	Ant1	5795	36.580	5776.7881	5813.3681	---	---
11AC80SISO	Ant1	5210	75.060	5172.7175	5247.7775	---	---
11AC80SISO	Ant2	5210	75.004	5172.6788	5247.6828	---	---
11AC80SISO	Ant2	5775	75.154	5737.5108	5812.6648	---	---
11AC80SISO	Ant1	5775	75.185	5737.4170	5812.6020	---	---
11AX20SISO	Ant1	5180	18.935	5170.5734	5189.5084	---	---
11AX20SISO	Ant2	5180	19.004	5170.5431	5189.5471	---	---
11AX20SISO	Ant1	5220	18.978	5210.5481	5229.5261	---	---
11AX20SISO	Ant2	5220	18.998	5210.5485	5229.5465	---	---
11AX20SISO	Ant1	5240	18.941	5230.5773	5249.5183	---	---
11AX20SISO	Ant2	5240	18.942	5230.5571	5249.4991	---	---
11AX20SISO	Ant2	5745	19.239	5735.3839	5754.6229	---	---
11AX20SISO	Ant1	5745	19.167	5735.4387	5754.6057	---	---
11AX20SISO	Ant2	5785	19.165	5775.4268	5794.5918	---	---
11AX20SISO	Ant1	5785	19.198	5775.4319	5794.6299	---	---
11AX20SISO	Ant2	5825	19.190	5815.4347	5834.6247	---	---
11AX20SISO	Ant1	5825	19.186	5815.4446	5834.6306	---	---
11AX40SISO	Ant1	5190	37.637	5171.2884	5208.9254	---	---
11AX40SISO	Ant2	5190	37.679	5171.2190	5208.8980	---	---
11AX40SISO	Ant1	5230	37.517	5211.3468	5248.8638	---	---
11AX40SISO	Ant2	5230	37.465	5211.3529	5248.8179	---	---
11AX40SISO	Ant2	5755	38.009	5736.0595	5774.0685	---	---
11AX40SISO	Ant1	5755	37.985	5736.0573	5774.0423	---	---
11AX40SISO	Ant2	5795	37.946	5776.1181	5814.0641	---	---
11AX40SISO	Ant1	5795	38.012	5776.0266	5814.0386	---	---
11AX80SISO	Ant1	5210	76.695	5171.9028	5248.5978	---	---
11AX80SISO	Ant2	5210	76.586	5171.8399	5248.4259	---	---
11AX80SISO	Ant2	5775	76.664	5736.6066	5813.2706	---	---
11AX80SISO	Ant1	5775	76.715	5736.7925	5813.5075	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

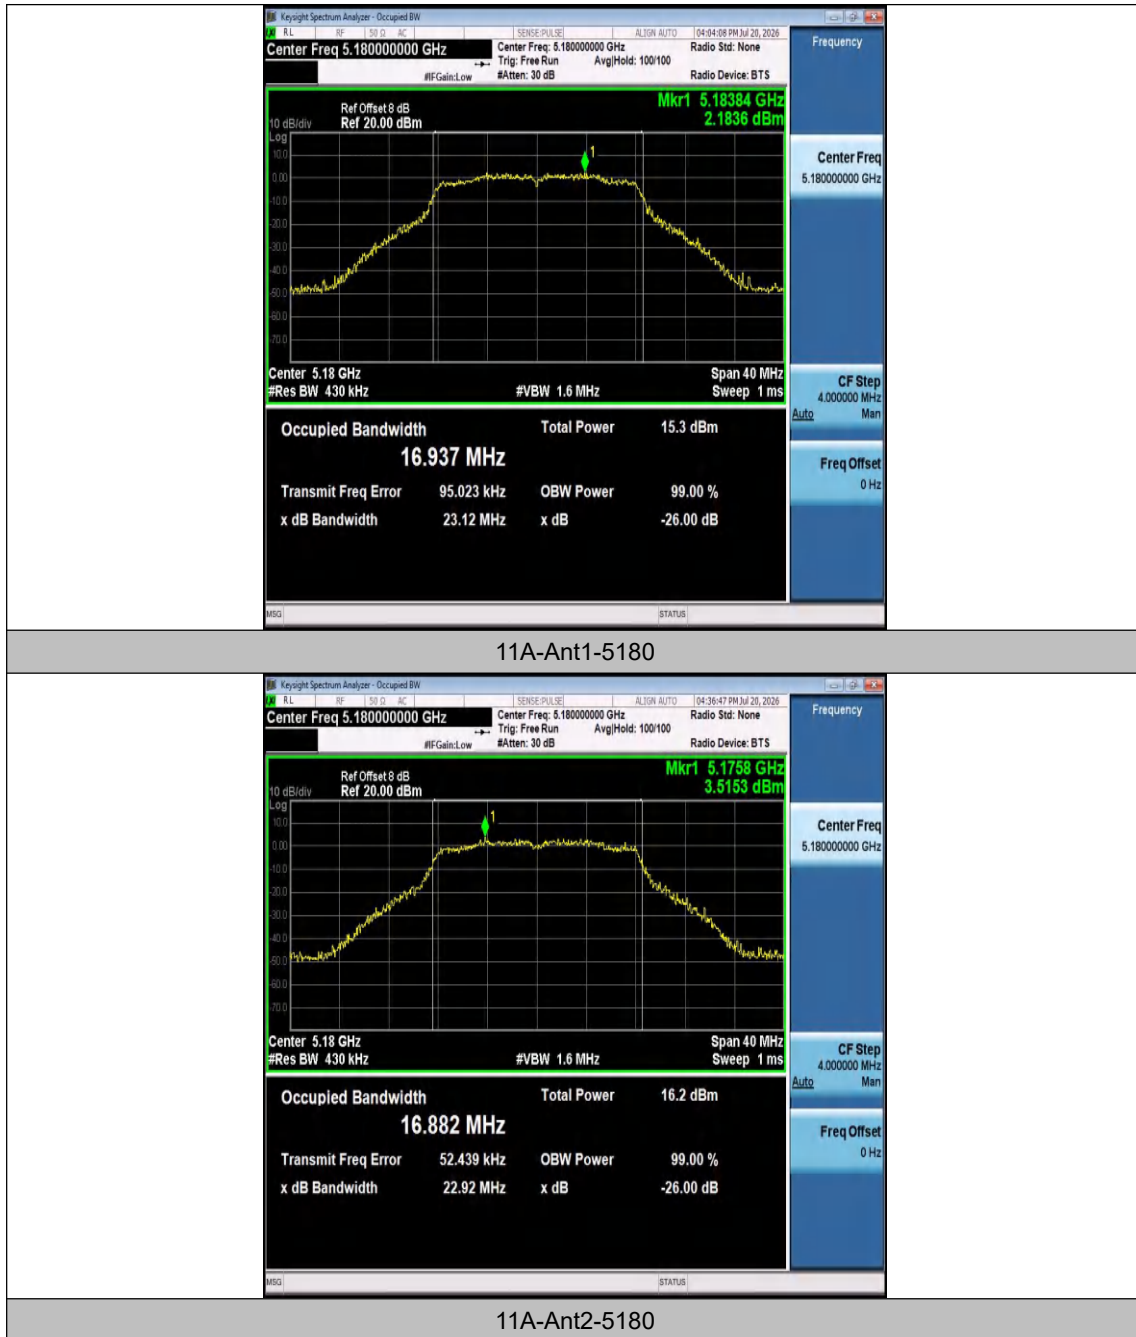

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

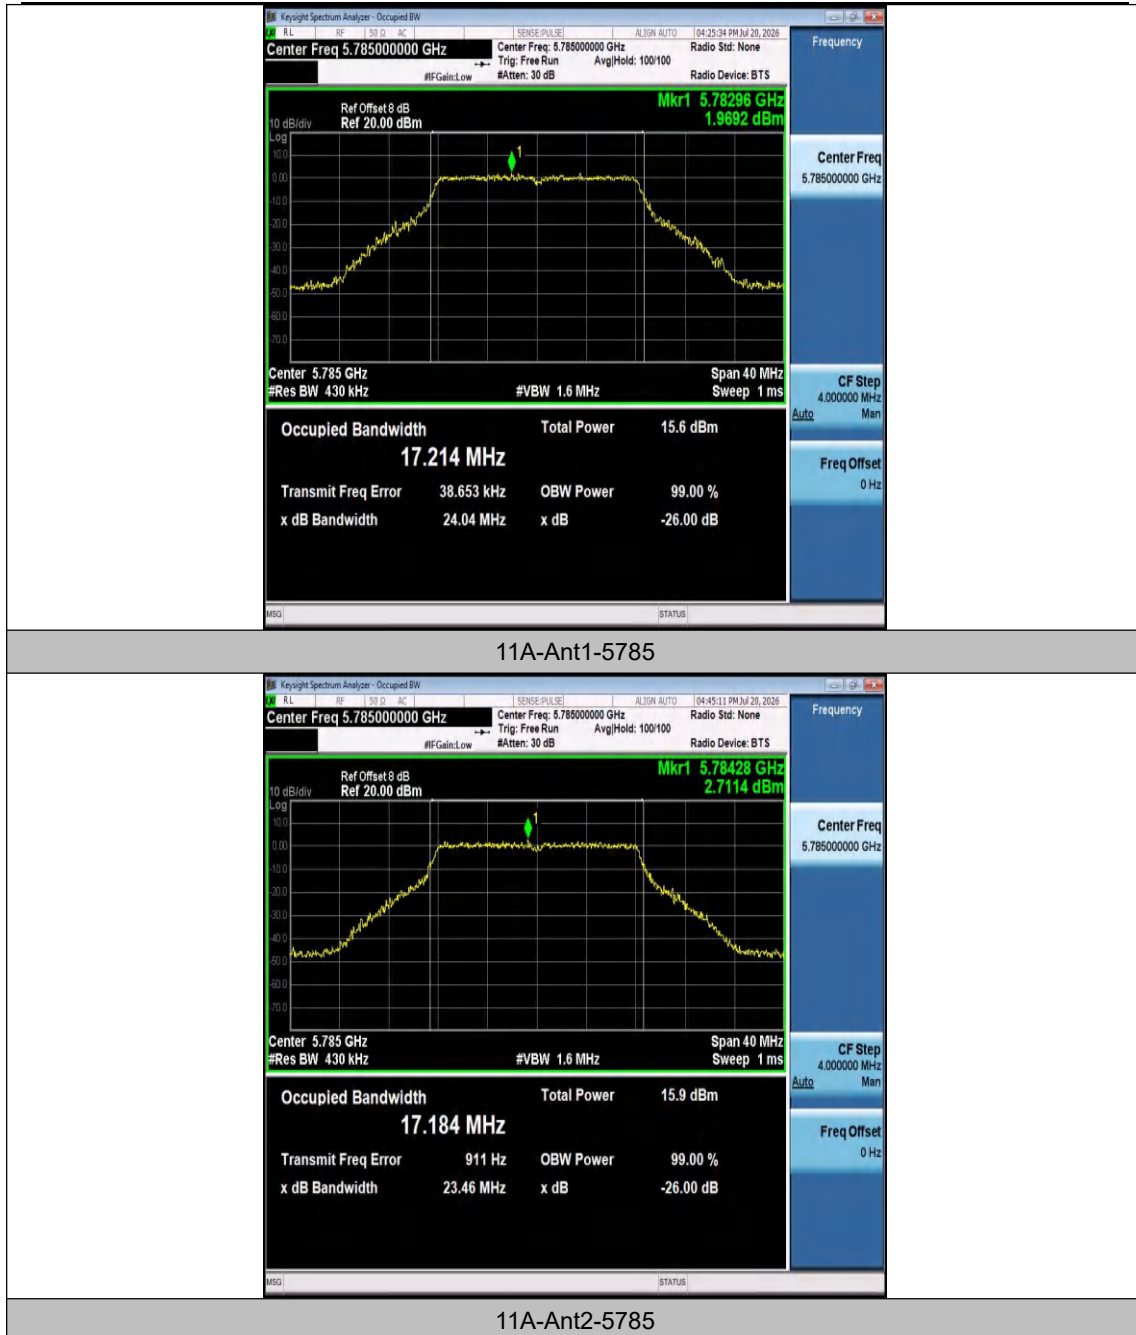

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

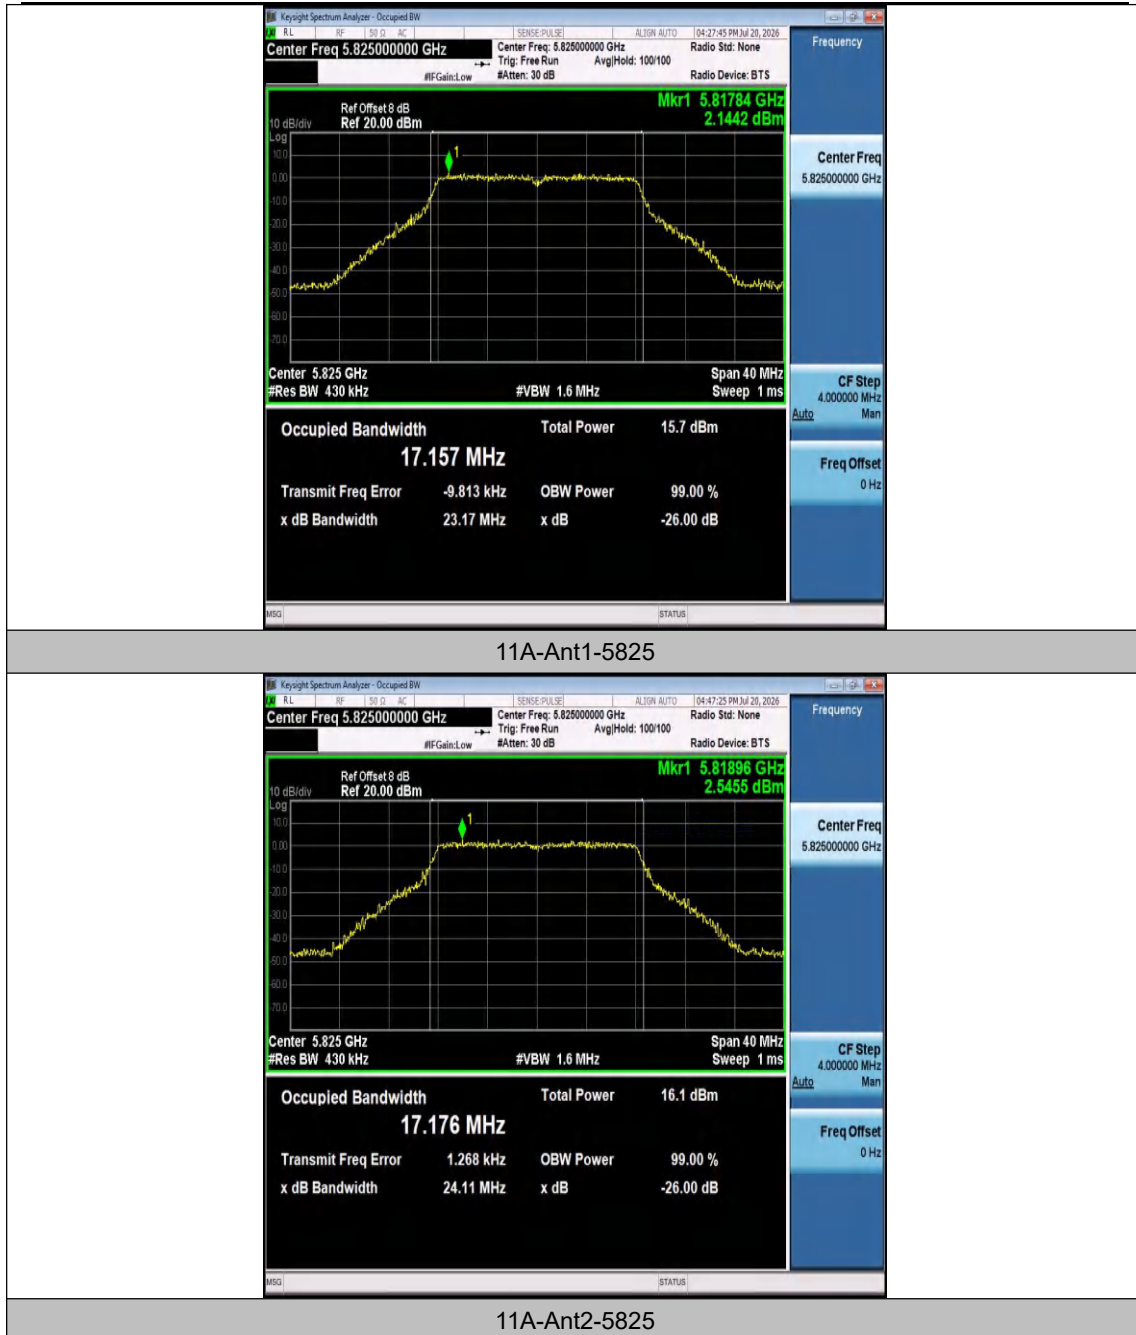

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

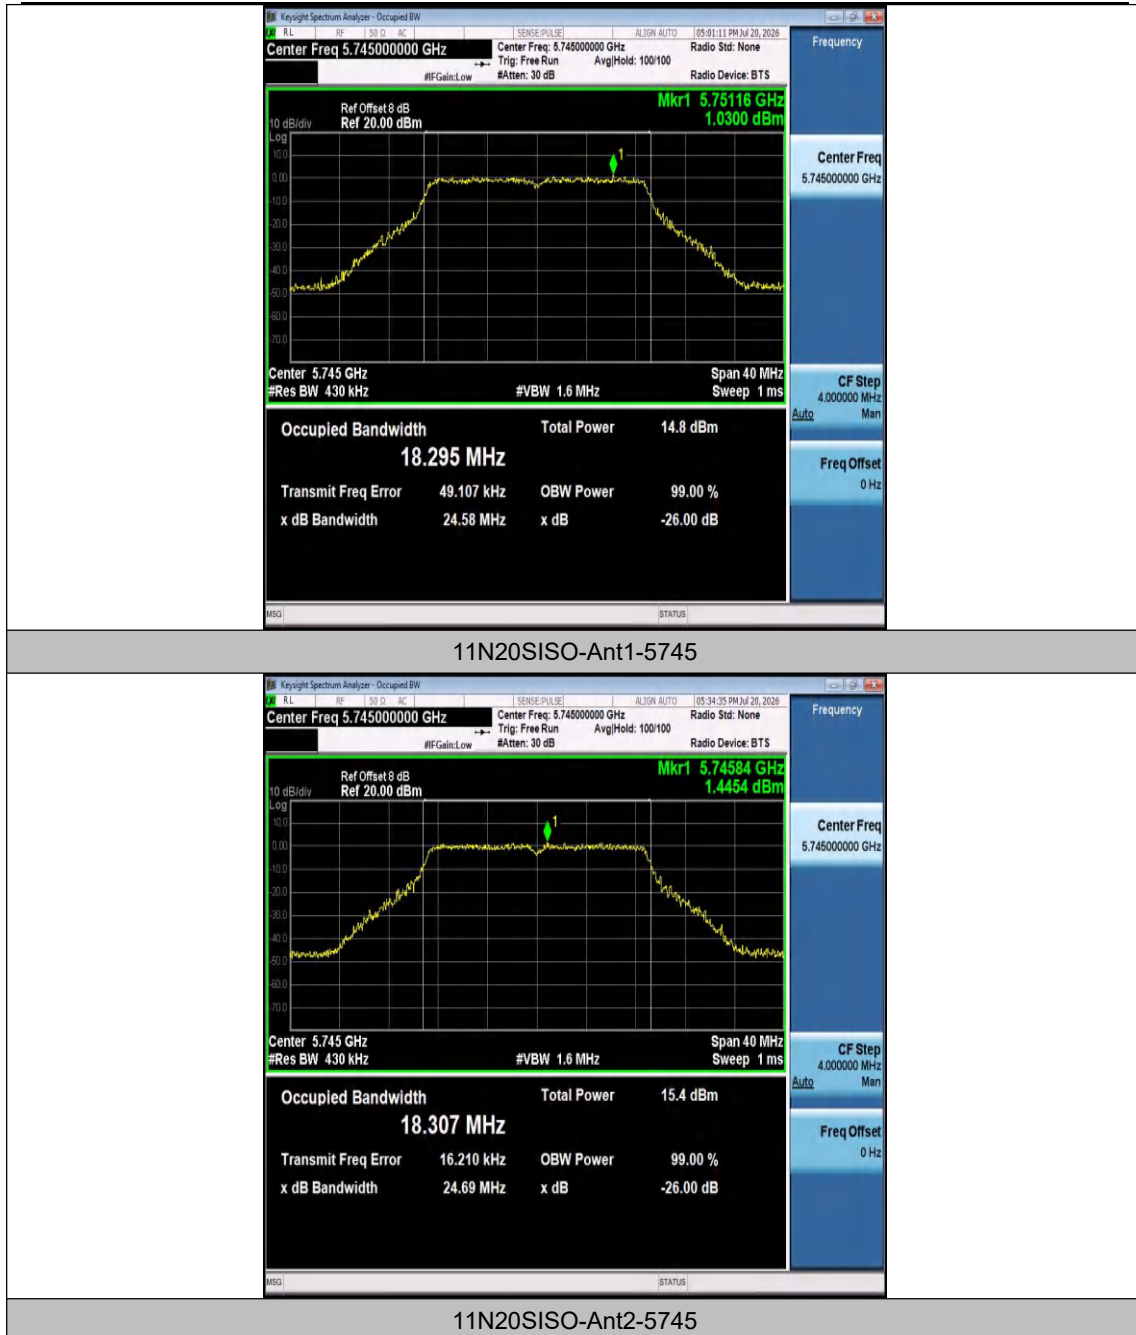

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

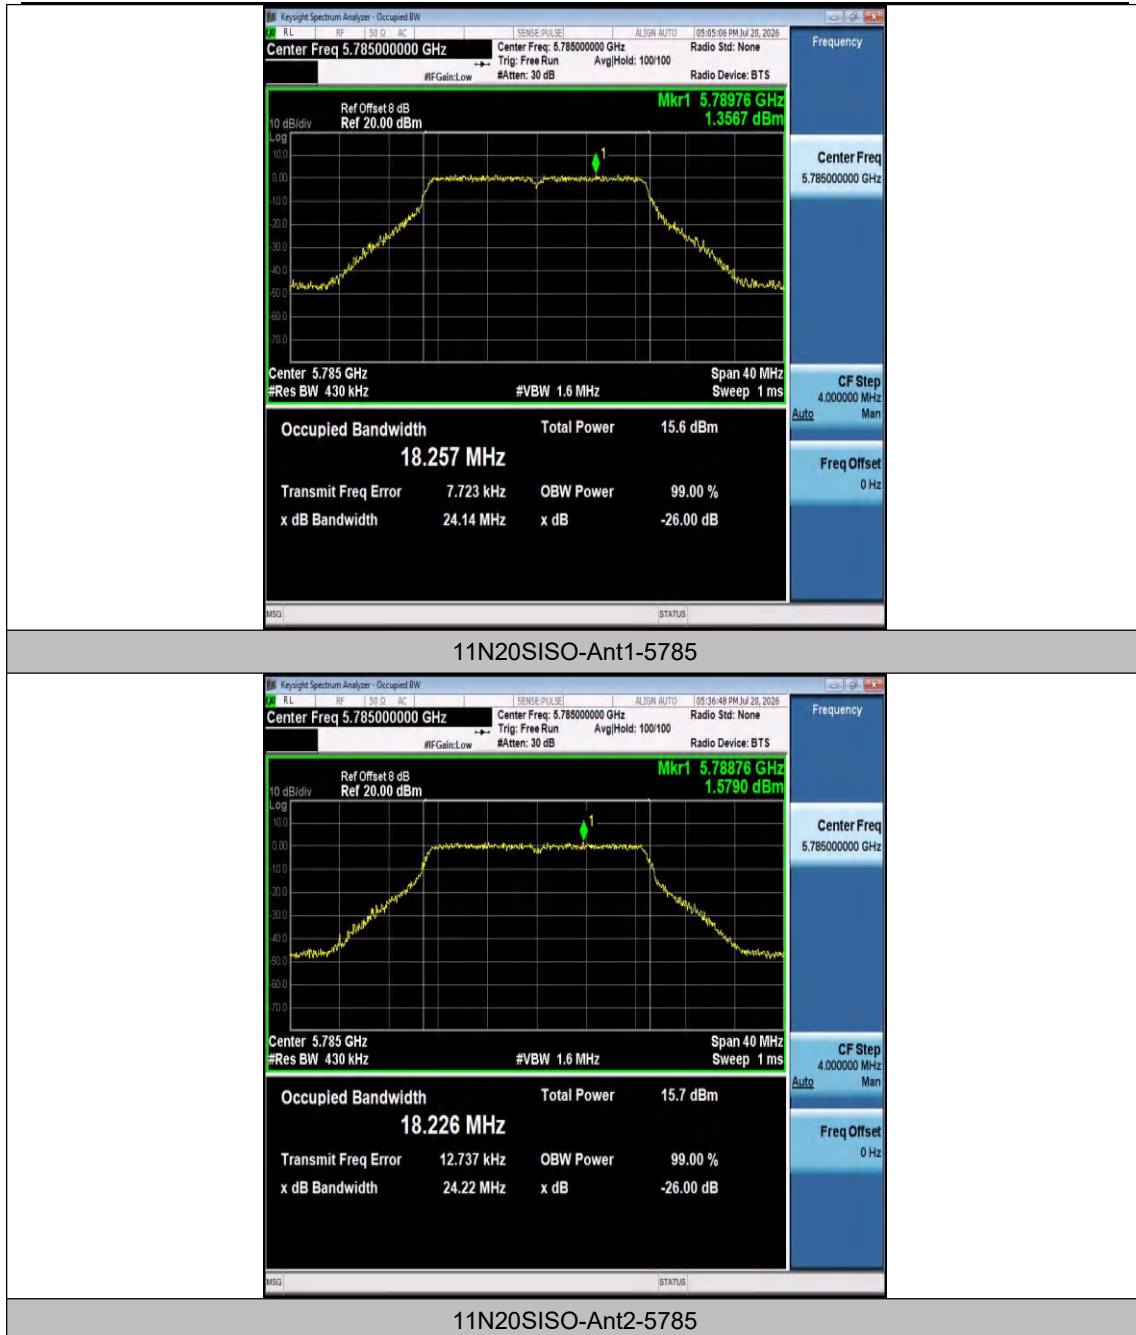

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

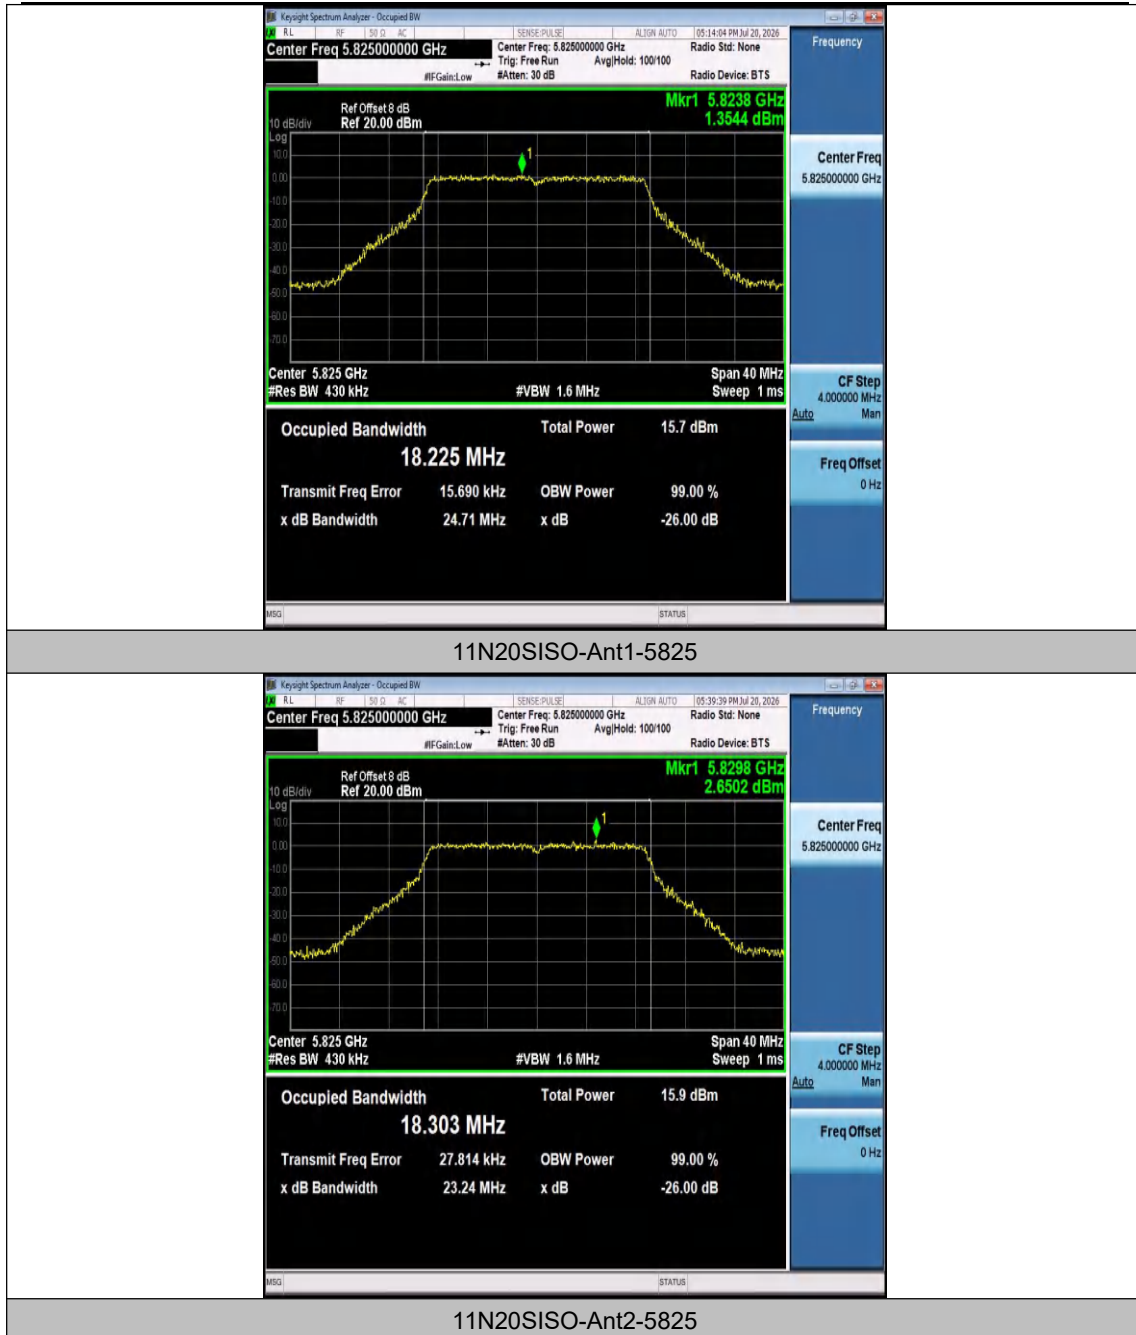

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

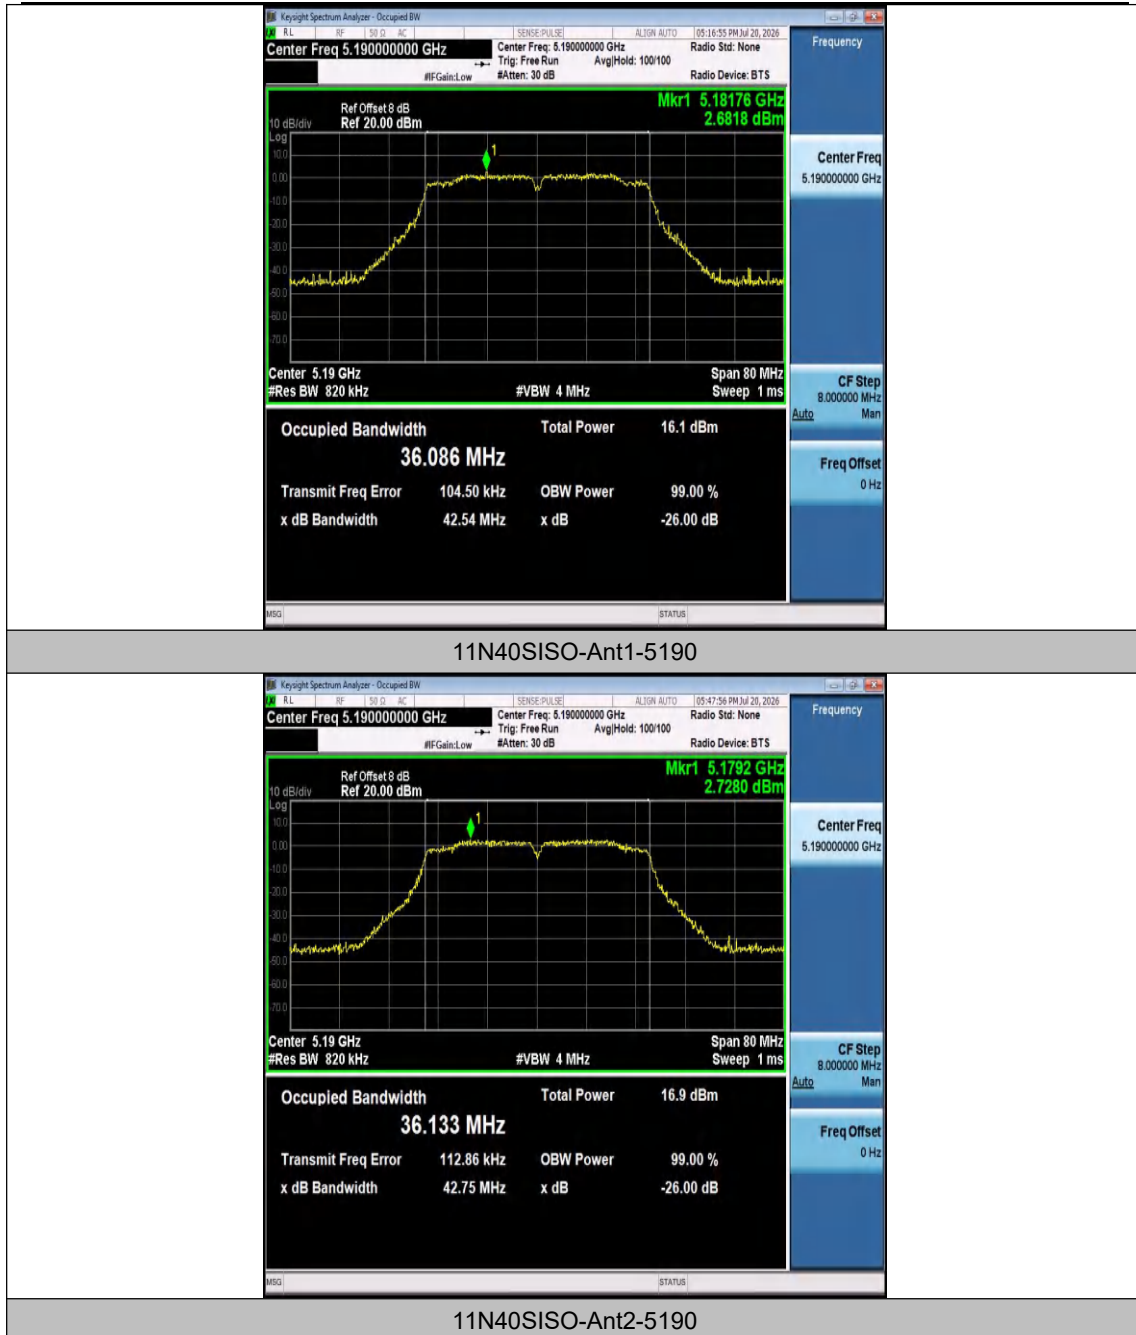

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

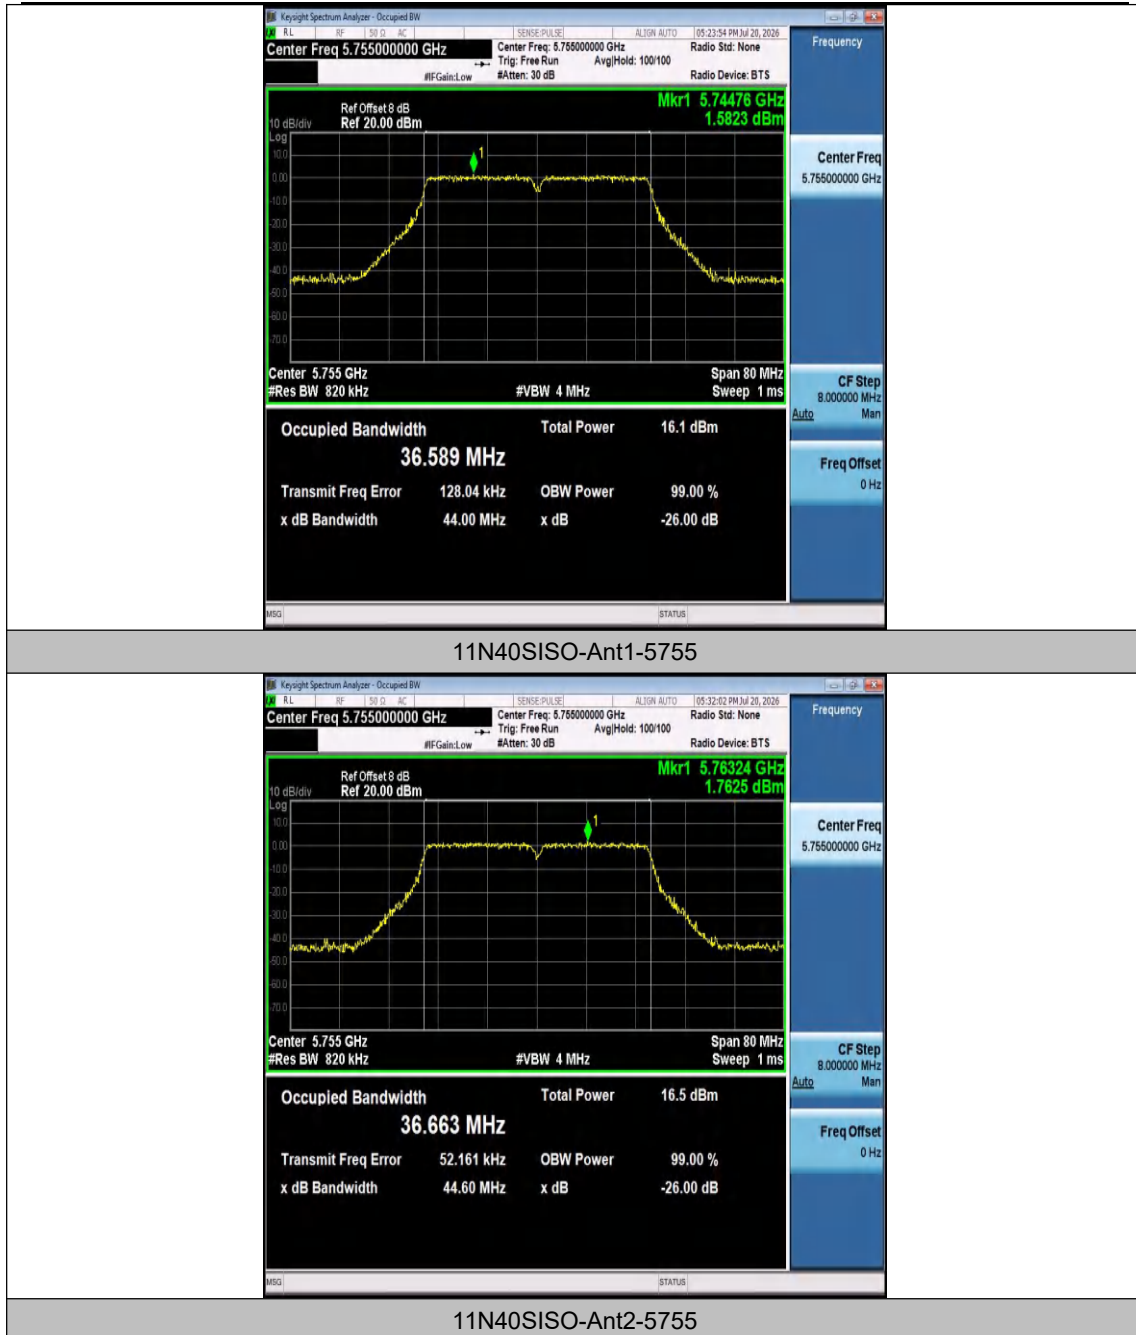

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

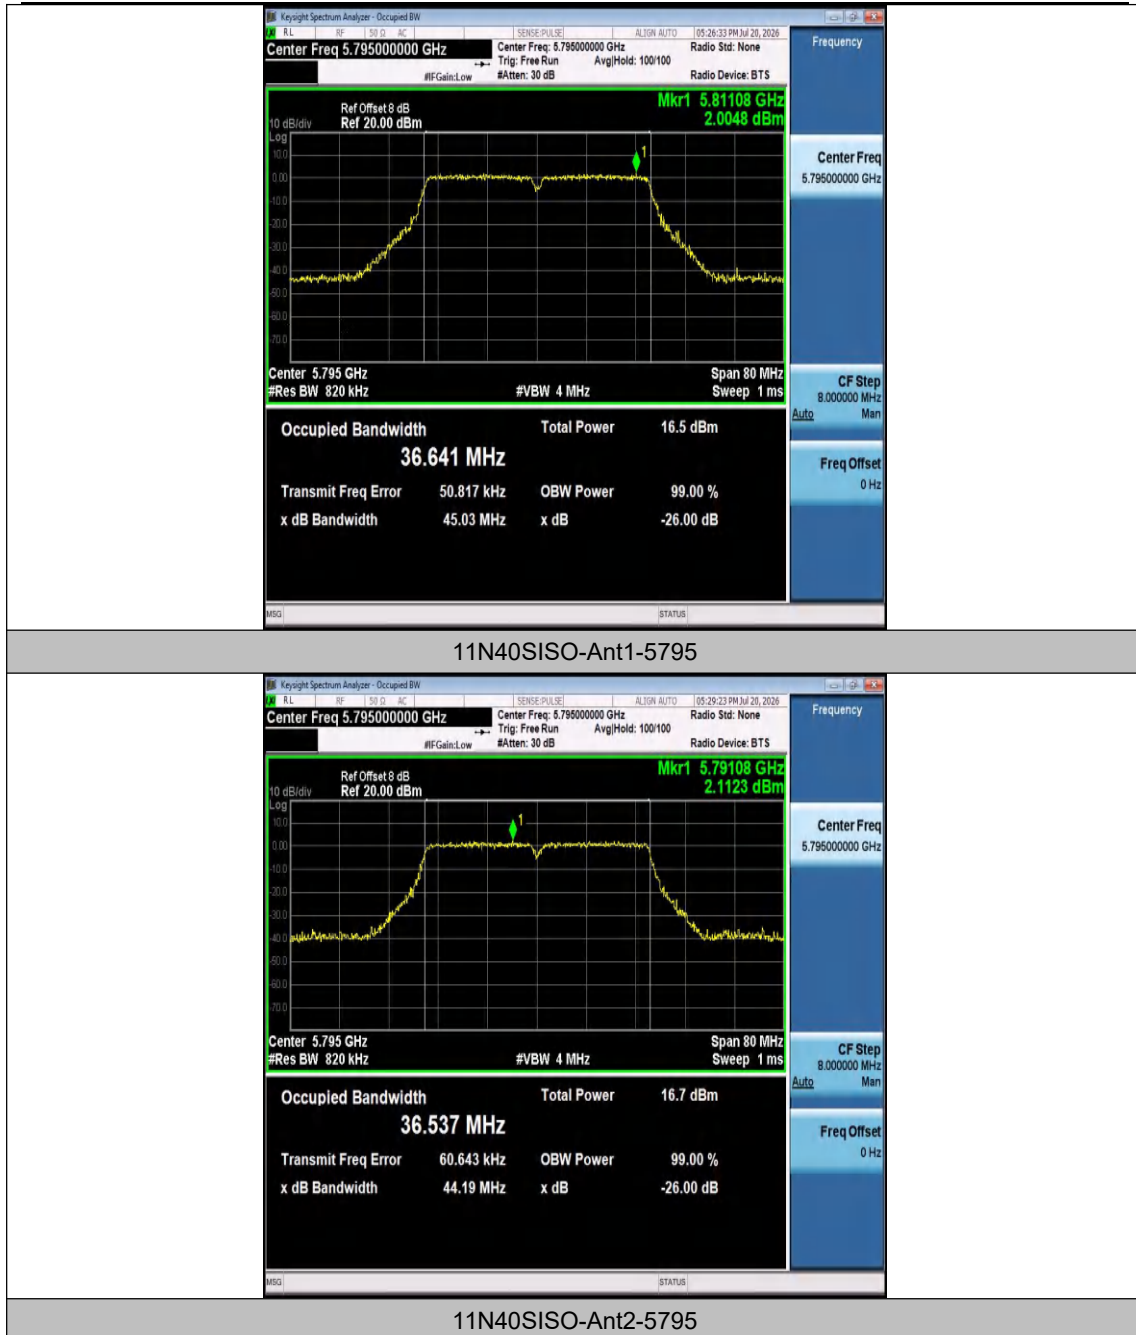

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

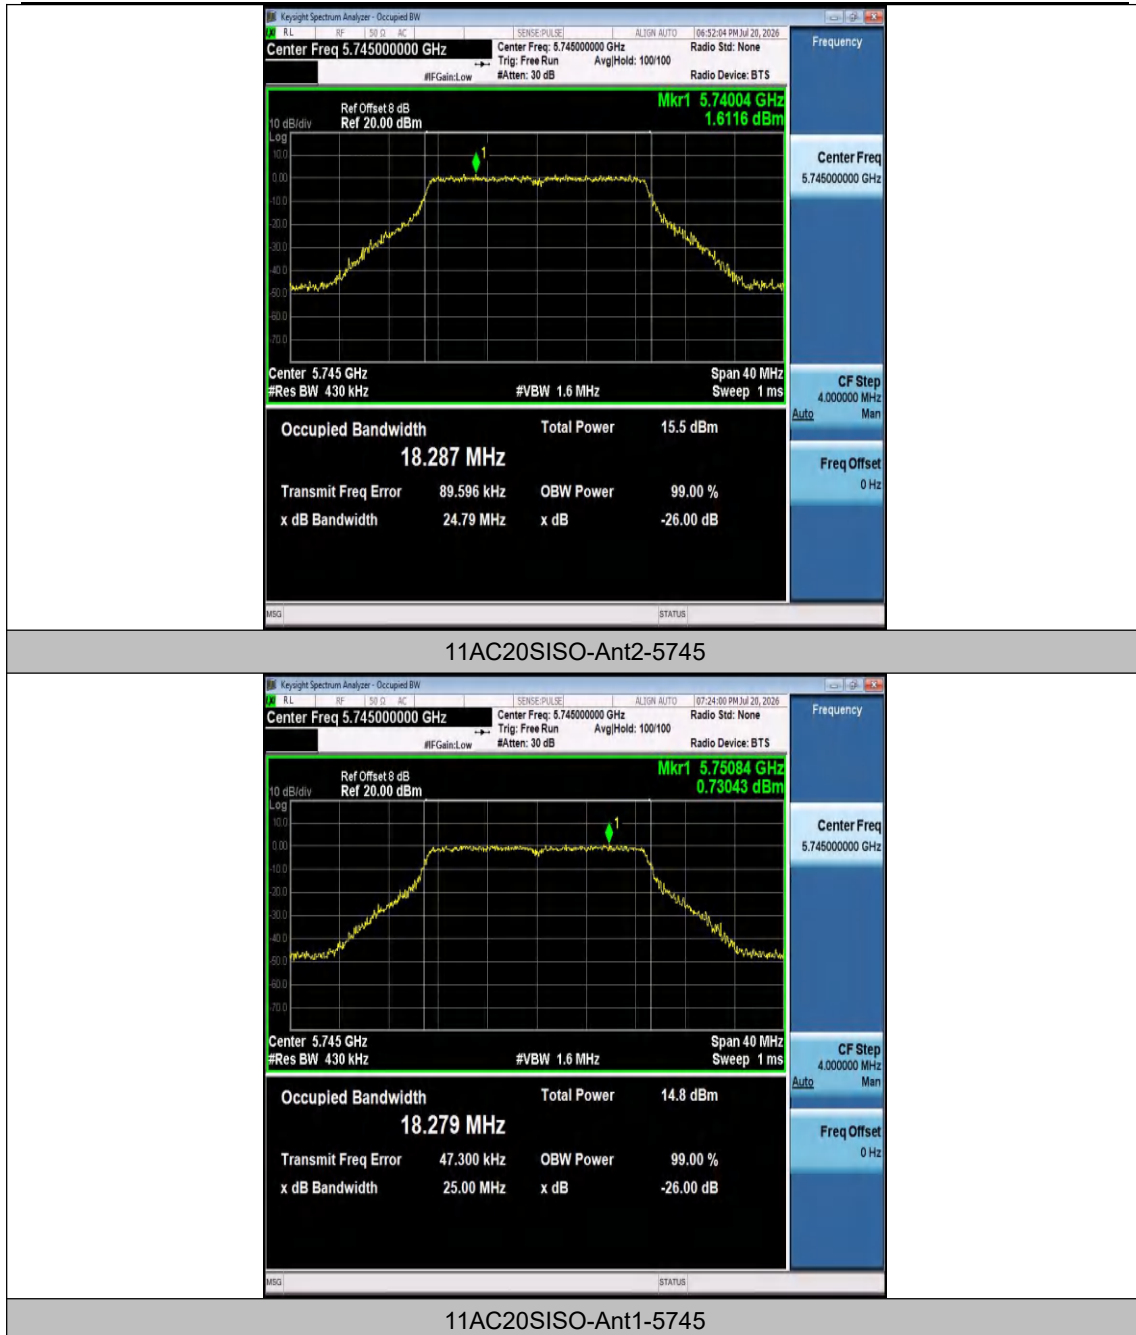

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

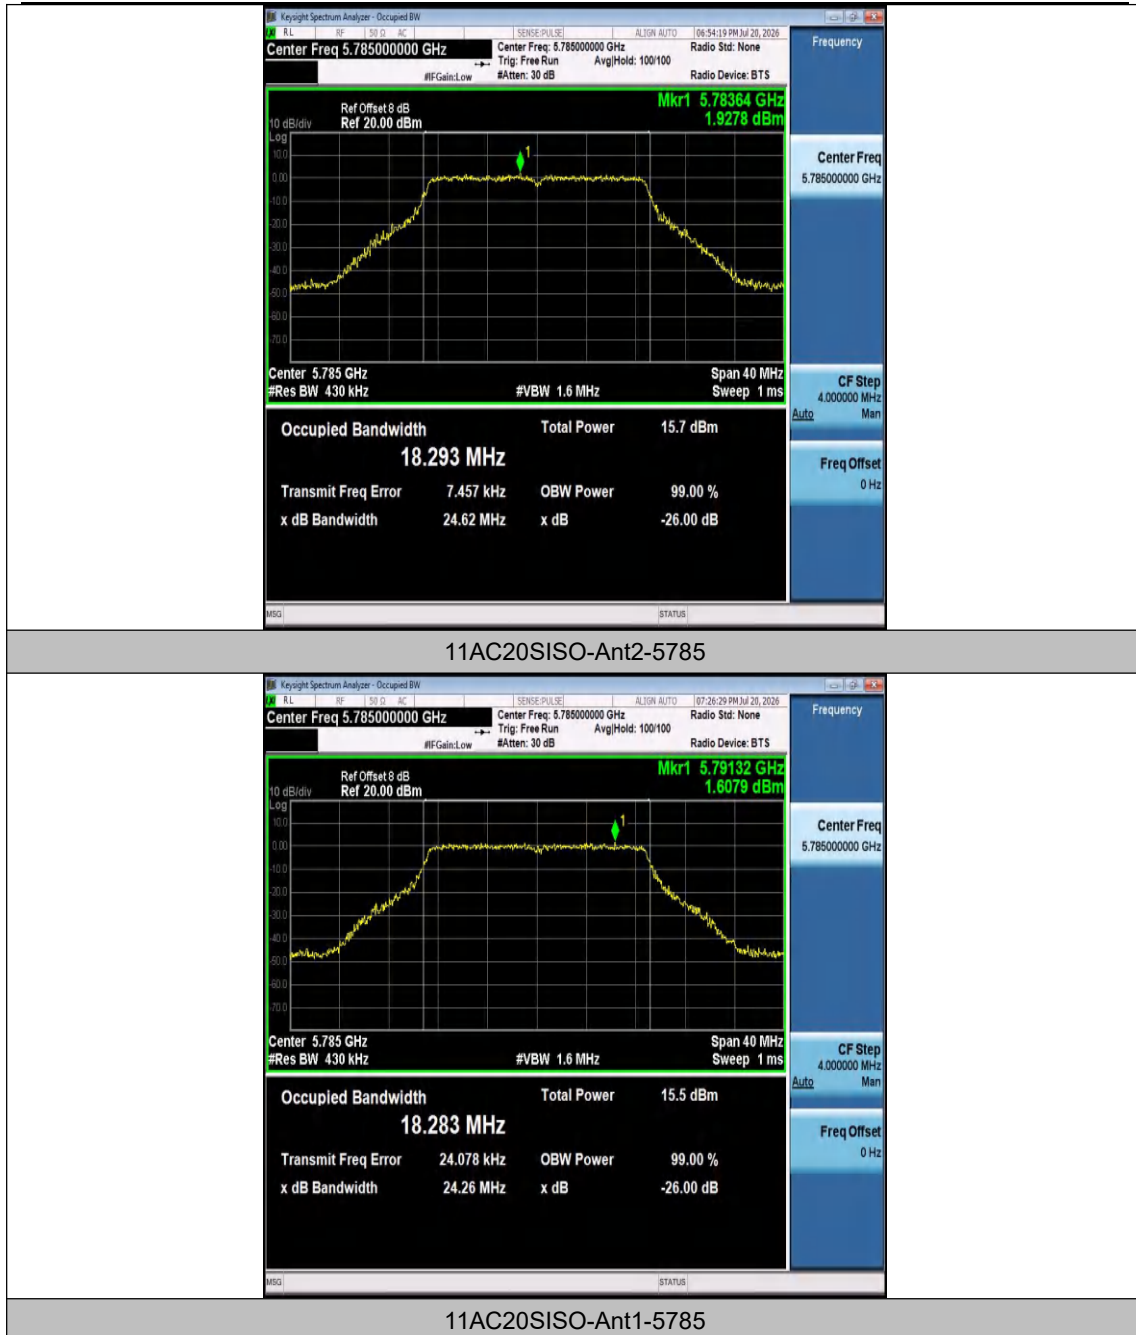

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

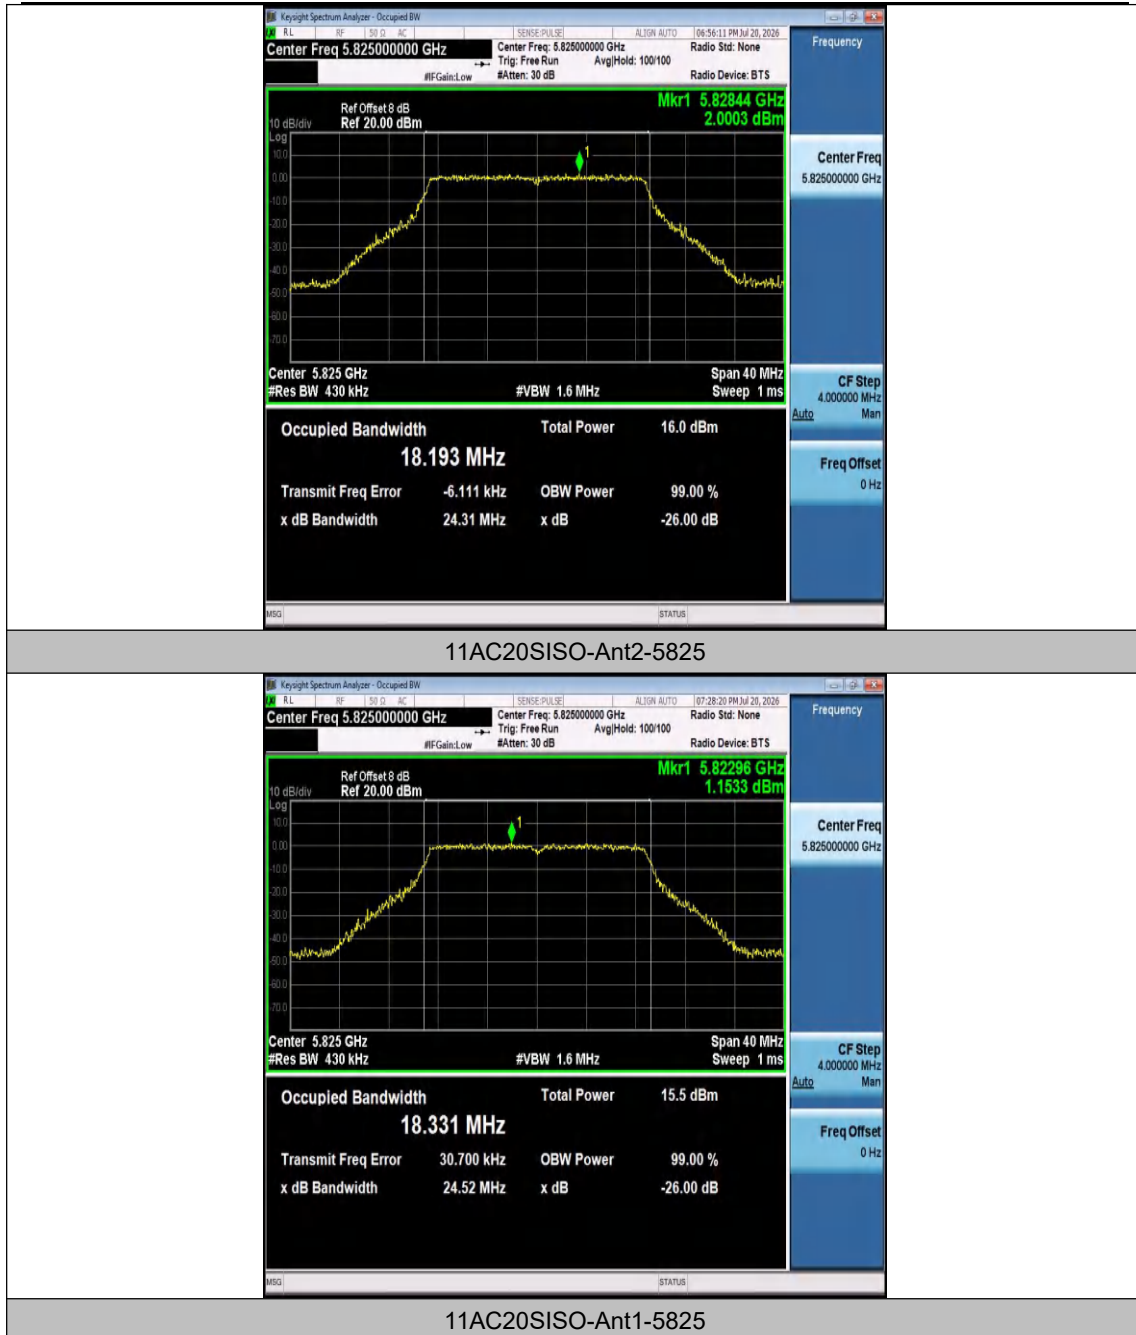

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

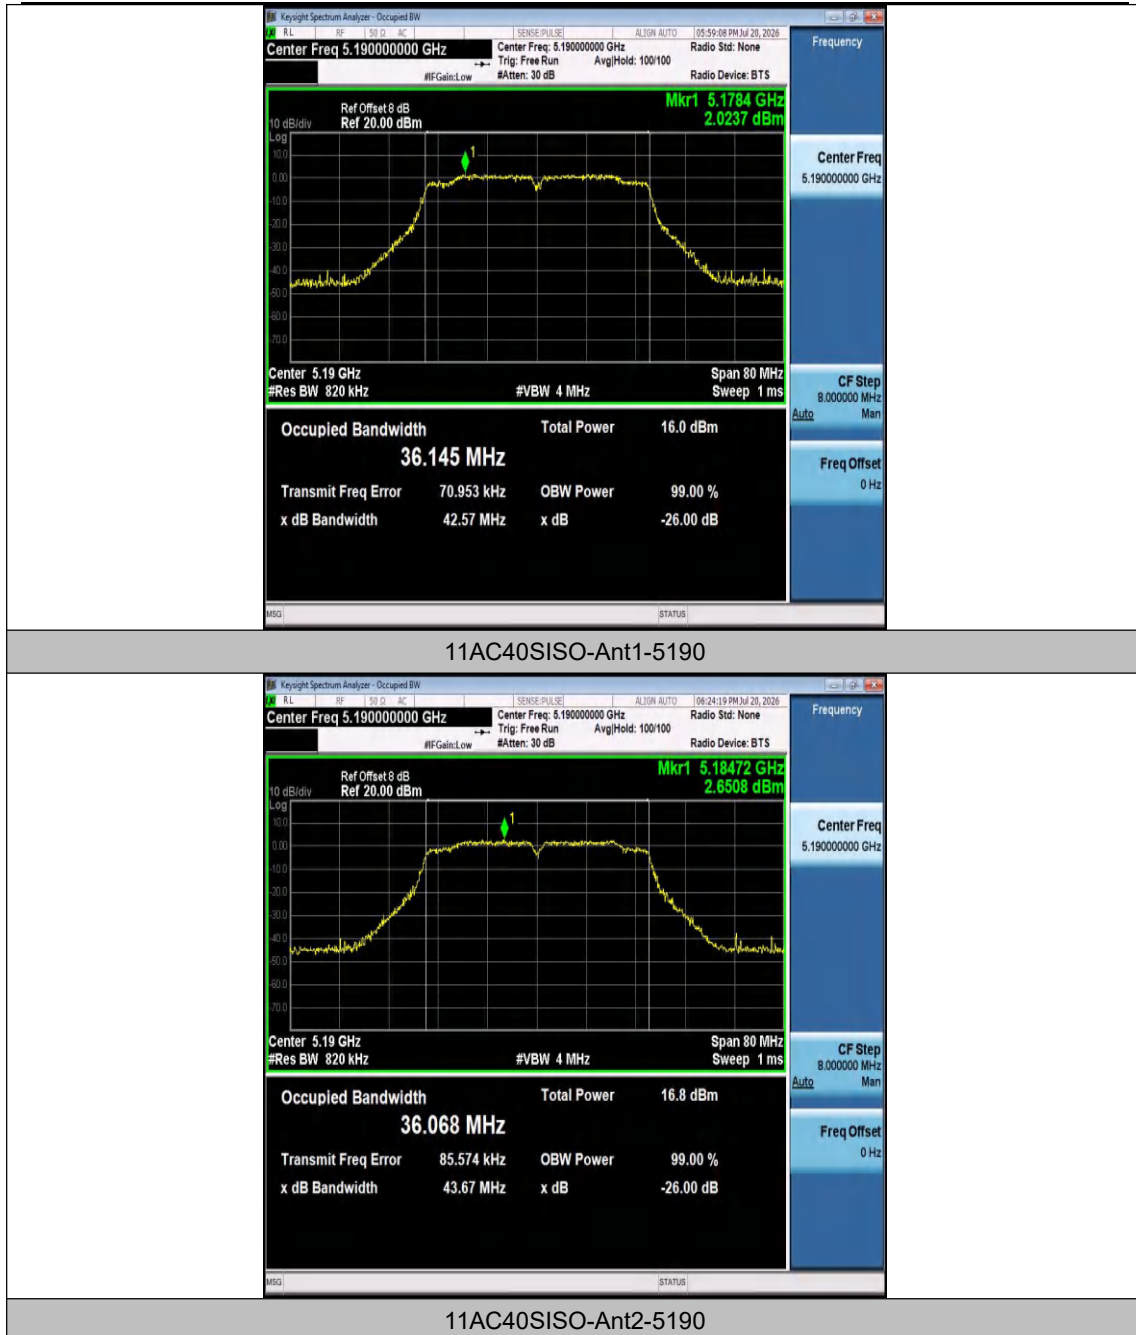

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com