



Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2607000296AT

Band4_10MHz_QPSK_HCH_1750MHz_RB_1_0_NTNV

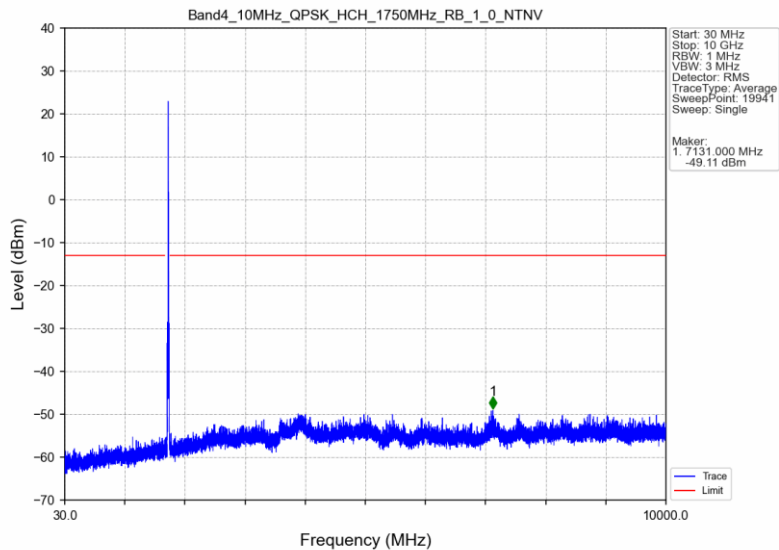


Band4_10MHz_QPSK_HCH_1750MHz_RB_1_0_NTNV

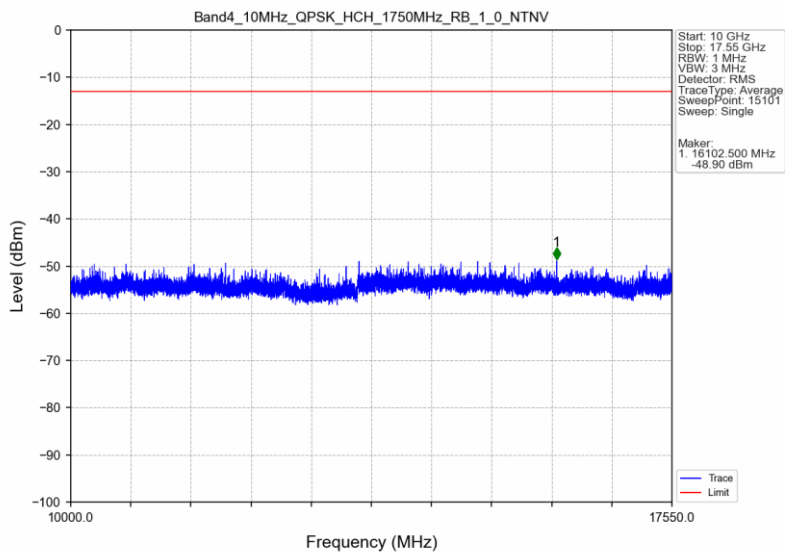

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch


Report No.: FYCR2607000296AT

Band4_10MHz_QPSK_HCH_1750MHz_RB_1_49_NTNV

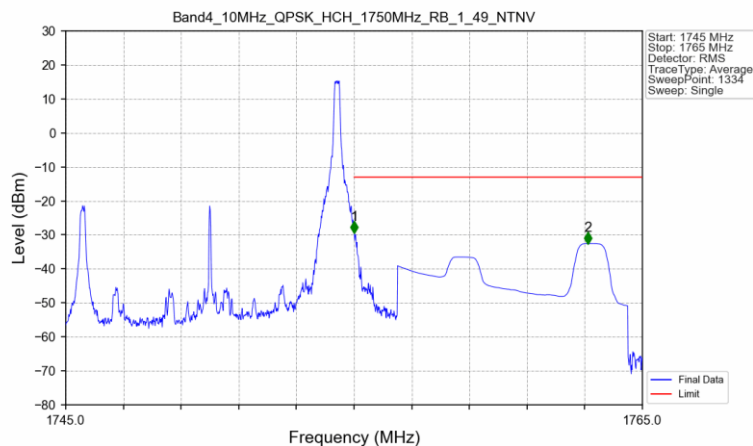

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
1745	1755	0.03	/	/	/	/	/	/
1755	1756	0.03	/	1	1755.008	-29.43	-13	Pass
1756	1765	1	CHP	2	1763.110	-32.57	-13	Pass

Band4_10MHz_QPSK_HCH_1750MHz_RB_50_0_NTNV

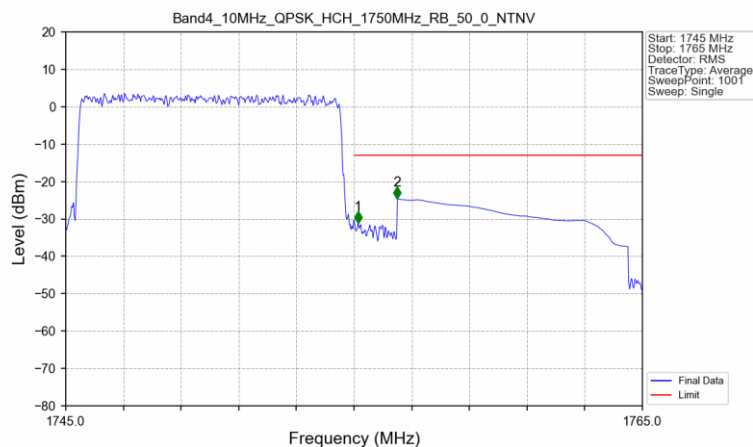


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
1745	1755	0.1	/	/	/	/	/	/
1755	1756	0.1	/	1	1755.140	-31.21	-13	Pass
1756	1765	1	CHP	2	1756.500	-24.63	-13	Pass

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2607000296AT


5.2.5 B4_15MHz

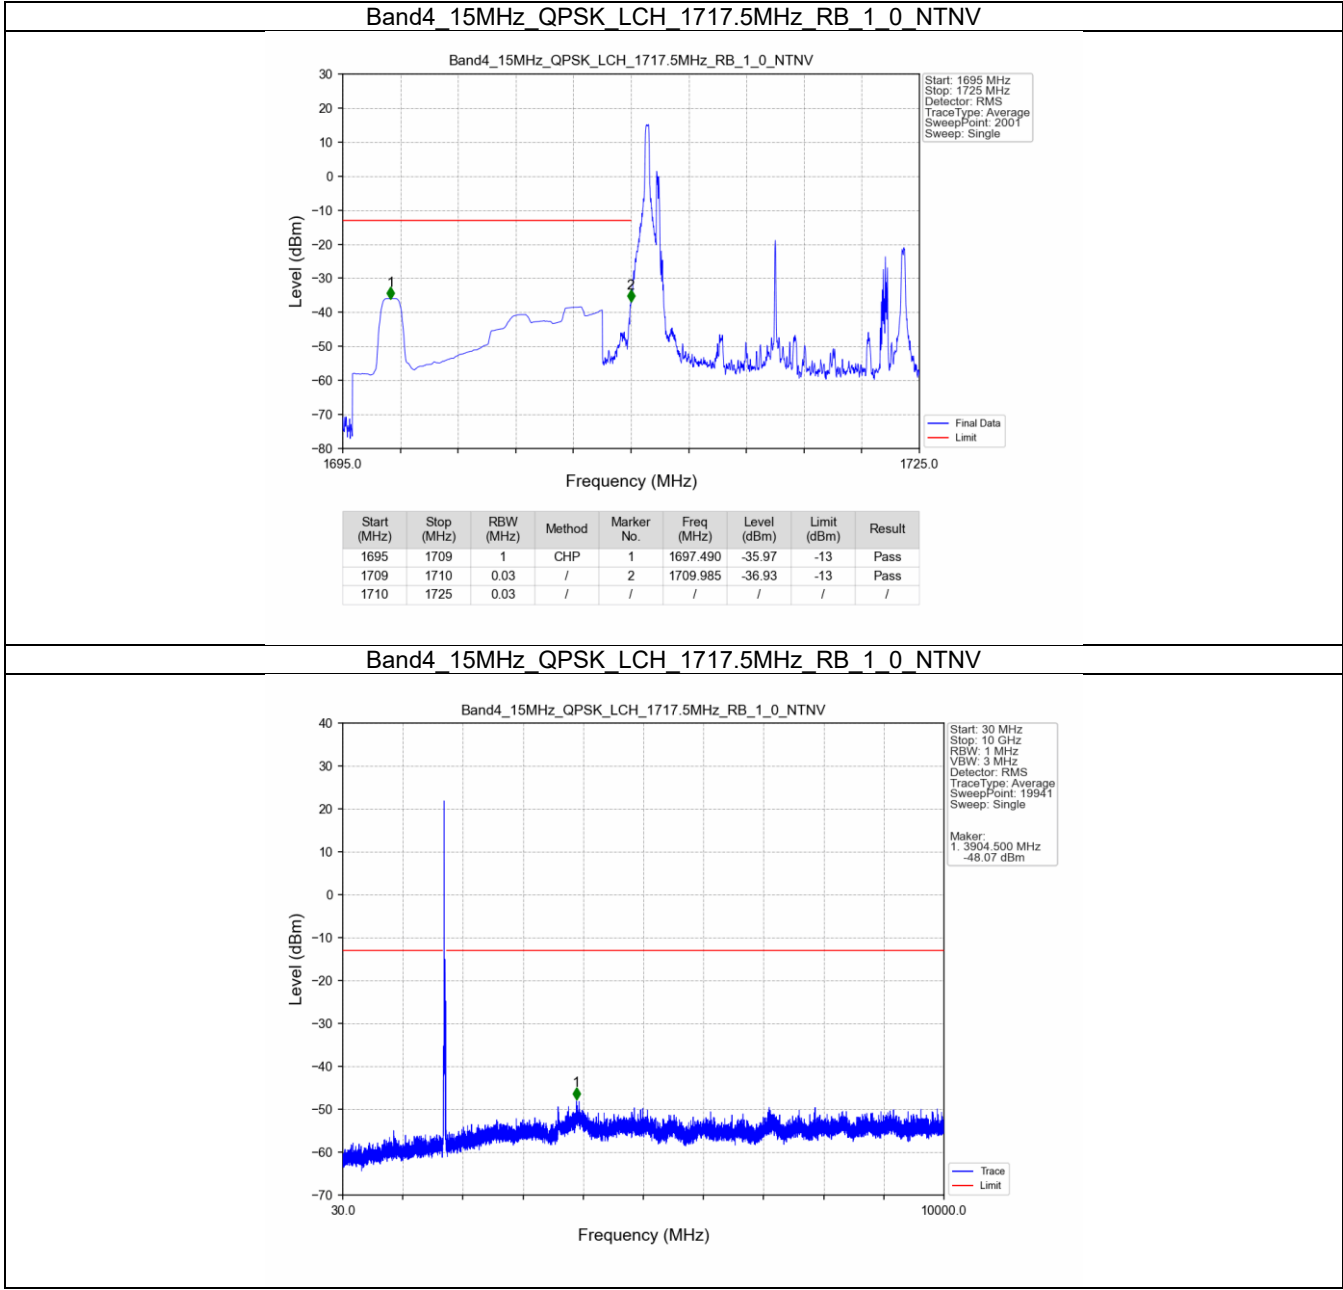


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2607000296AT

Band4_15MHz_QPSK_LCH_1717.5MHz_RB_1_0_NTNV

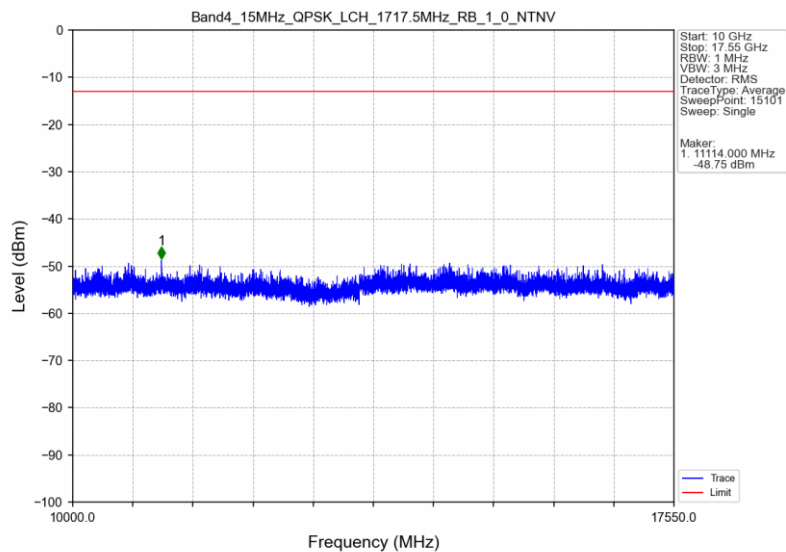

Band4_15MHz_QPSK_LCH_1717.5MHz_RB_75_0_NTNV

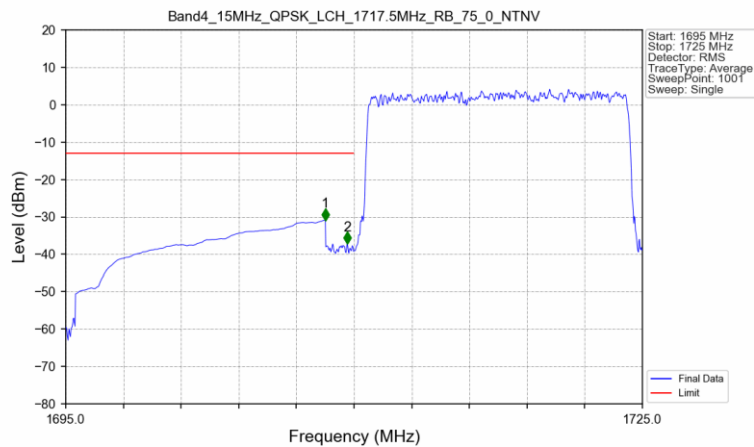


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
1695	1709	1	CHP	1	1708.500	-30.86	-13	Pass
1709	1710	0.15	/	2	1709.640	-37.12	-13	Pass
1710	1725	0.15	/	/	/	/	/	/


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2607000296AT

Band4_15MHz_QPSK_MCH_1732.5MHz_RB_1_0_NTNV

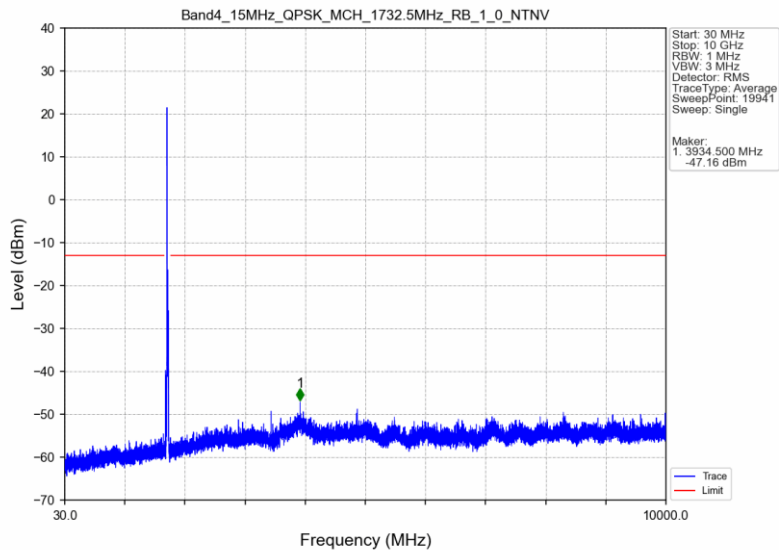


Band4_15MHz_QPSK_MCH_1732.5MHz_RB_1_0_NTNV

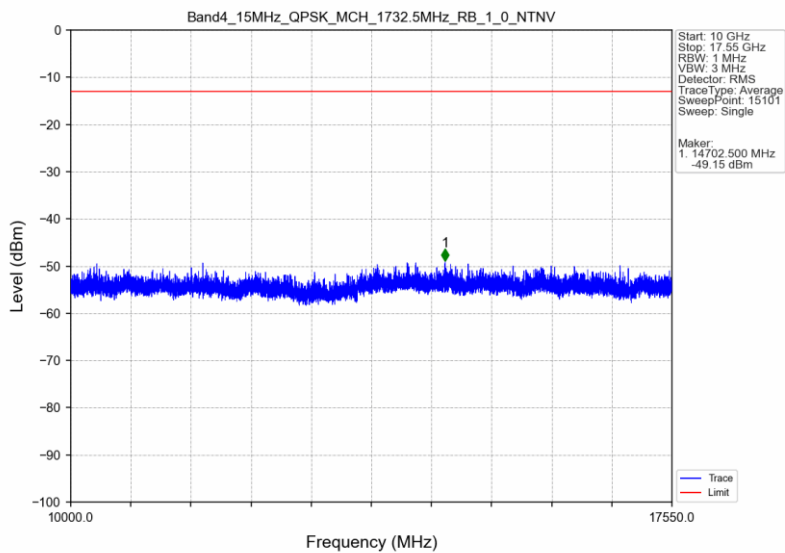


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2607000296AT

Band4_15MHz_QPSK_HCH_1747.5MHz_RB_1_0_NTNV

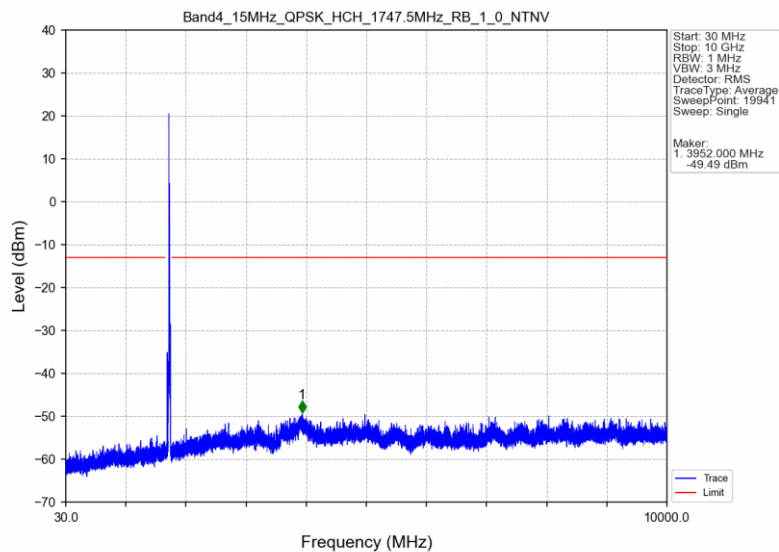


Band4_15MHz_QPSK_HCH_1747.5MHz_RB_1_0_NTNV

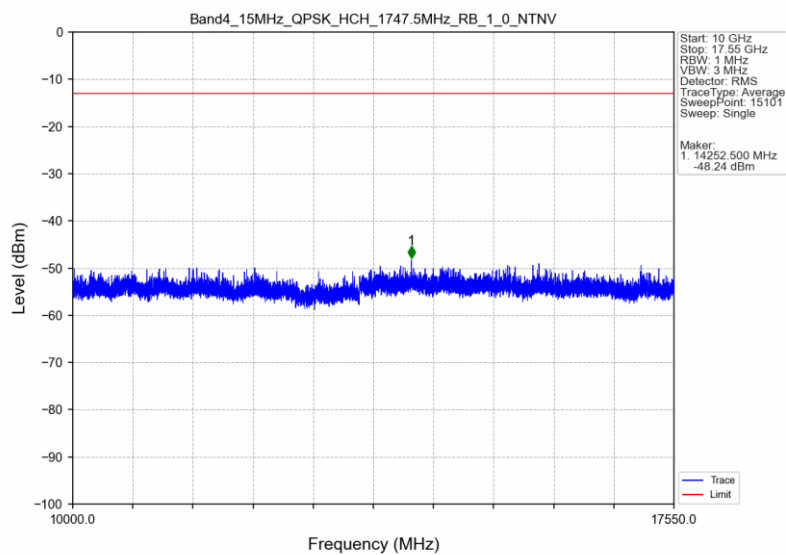


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2607000296AT

Band4_15MHz_QPSK_HCH_1747.5MHz_RB_1_74_NTV

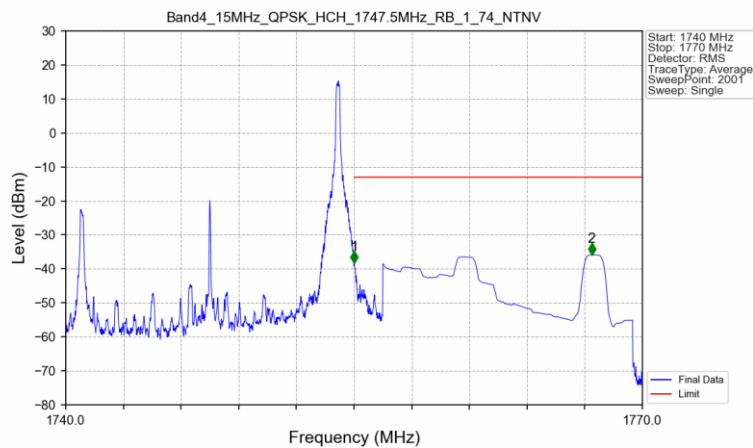


Band4_15MHz_QPSK_HCH_1747.5MHz_RB_75_0_NTV

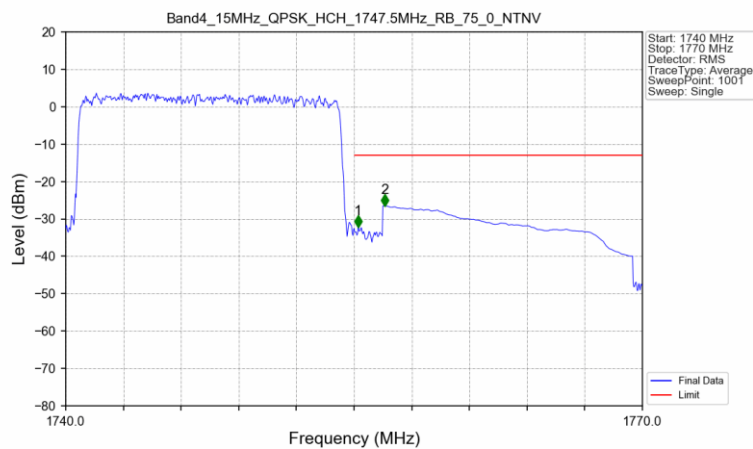

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2607000296AT


5.2.6 B4_20MHz

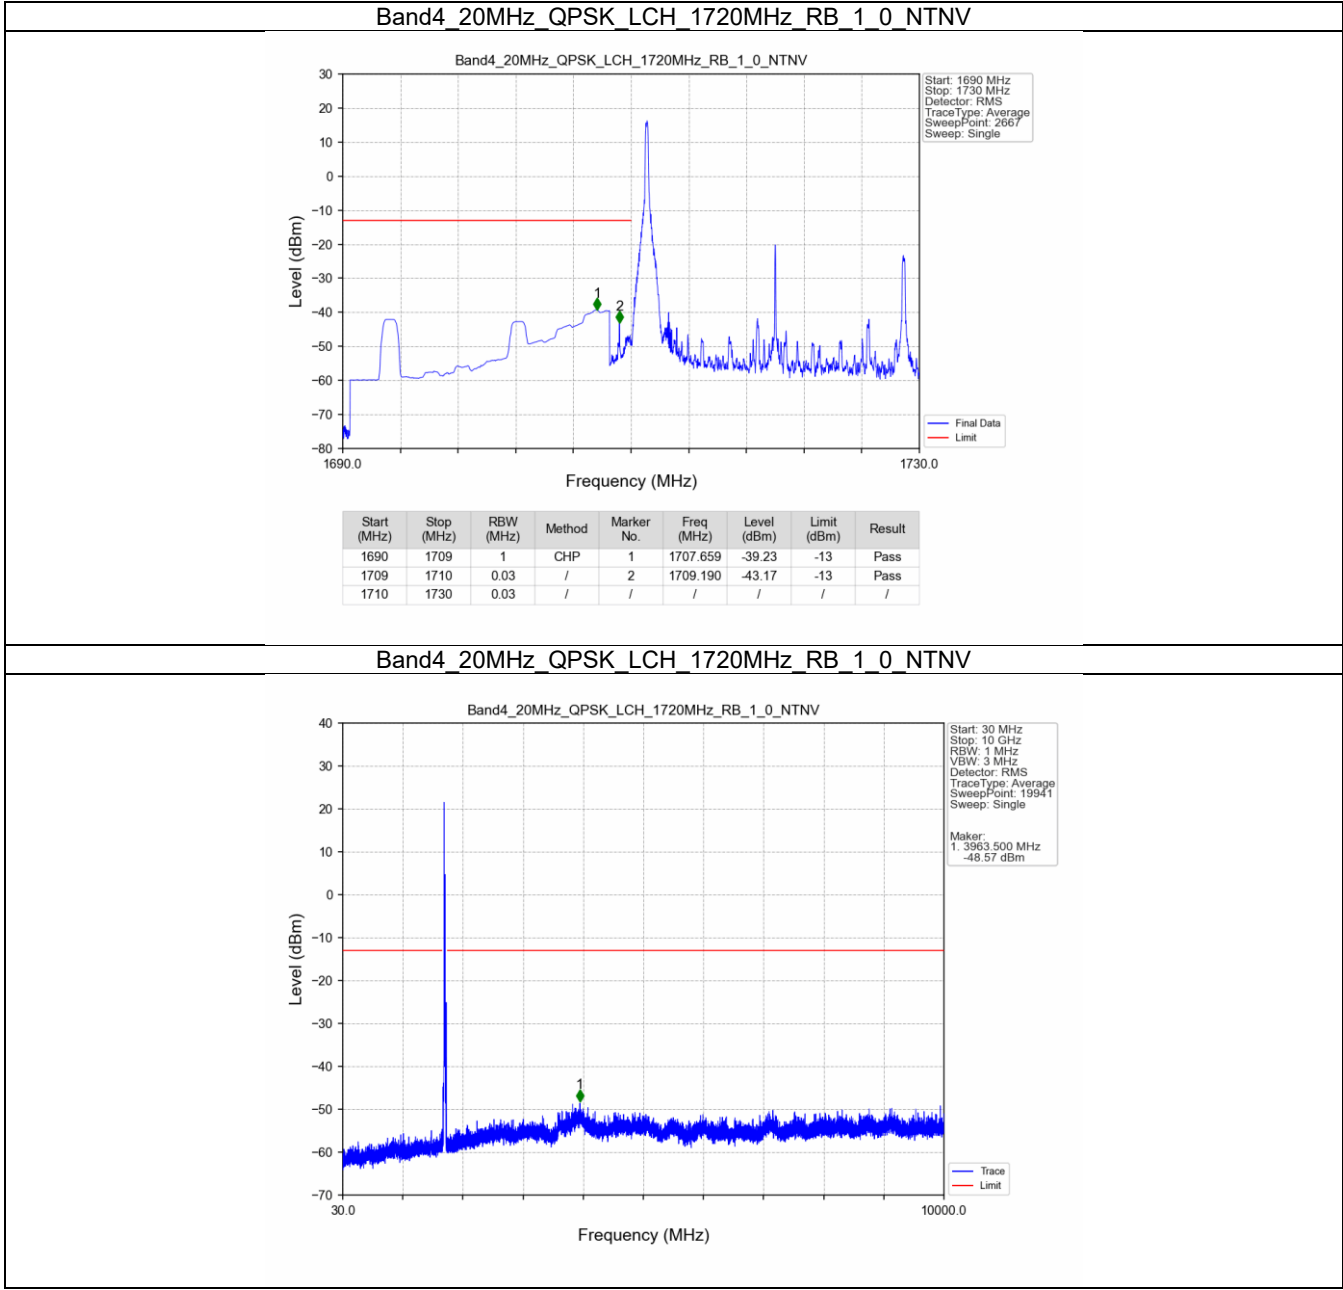


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2607000296AT

Band4_20MHz_QPSK_LCH_1720MHz_RB_1_0_NTNV

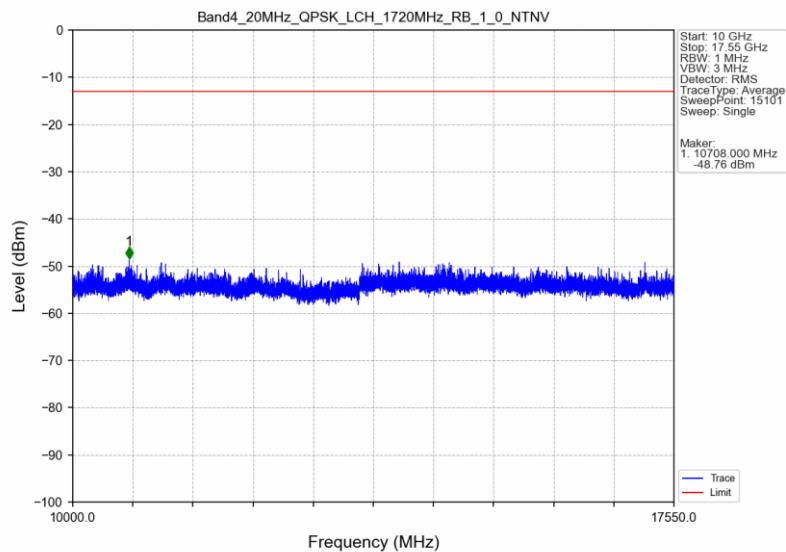

Band4_20MHz_QPSK_LCH_1720MHz_RB_100_0_NTNV

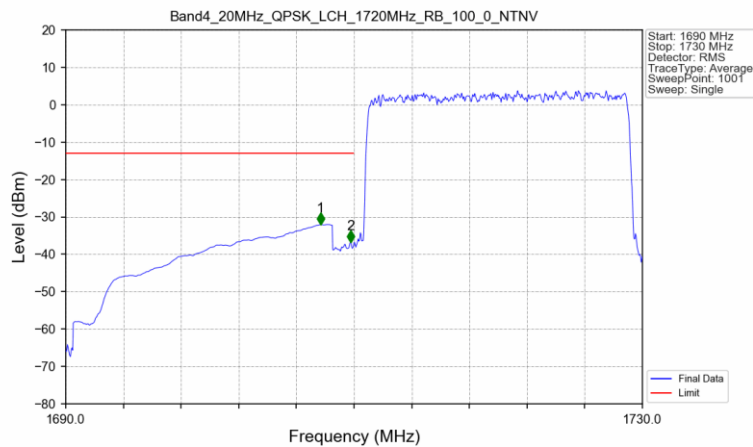


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
1690	1709	1	CHP	1	1707.680	-32.05	-13	Pass
1709	1710	0.2	/	2	1709.760	-36.77	-13	Pass
1710	1730	0.2	/	/	/	/	/	/


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2607000296AT

Band4_20MHz_QPSK_MCH_1732.5MHz_RB_1_0_NTNV

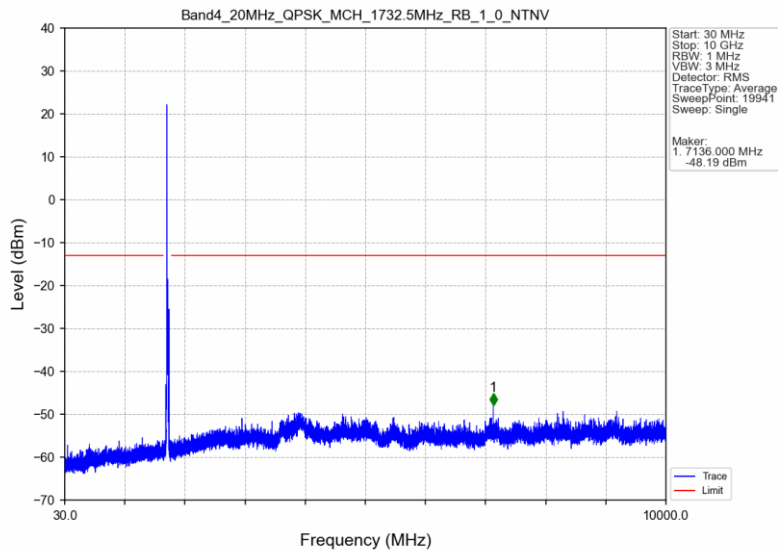


Band4_20MHz_QPSK_MCH_1732.5MHz_RB_1_0_NTNV

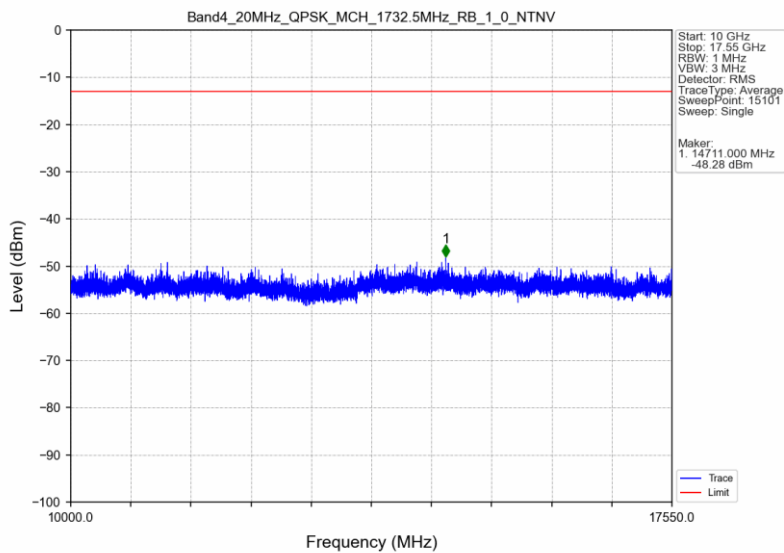


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2607000296AT

Band4_20MHz_QPSK_HCH_1745MHz_RB_1_0_NTNV

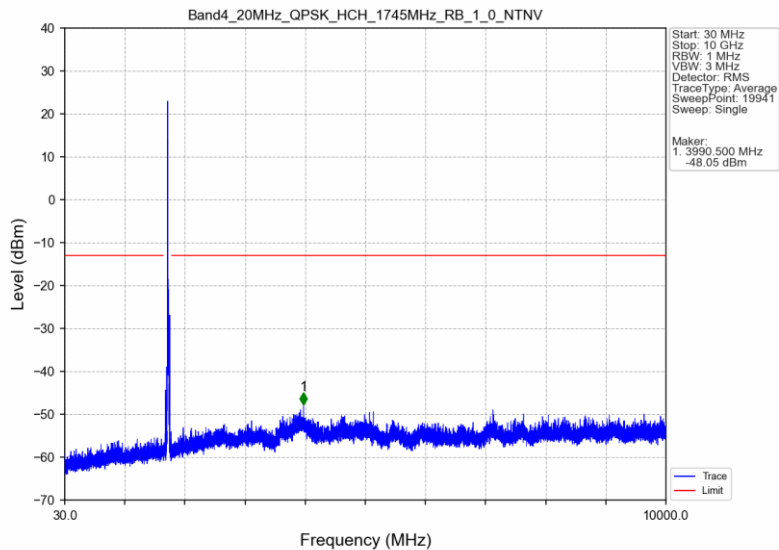


Band4_20MHz_QPSK_HCH_1745MHz_RB_1_0_NTNV

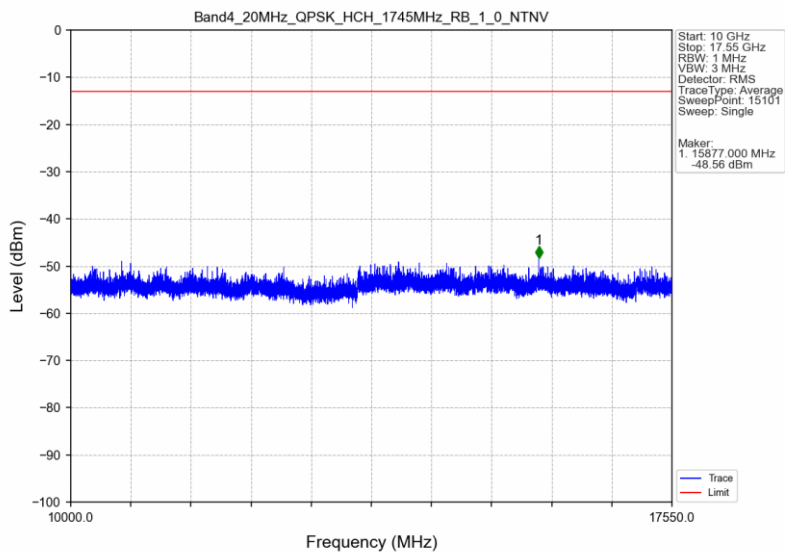

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch


Report No.: FYCR2607000296AT

Band4_20MHz_QPSK_HCH_1745MHz_RB_1_99_NTNV

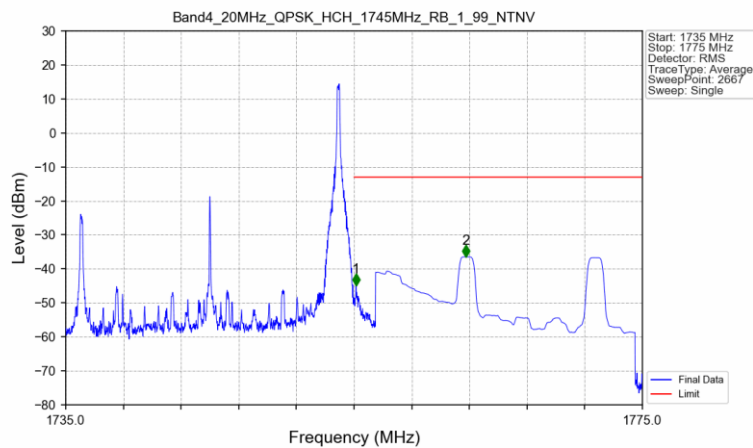

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
1735	1755	0.03	/	/	/	/	/	/
1755	1756	0.03	/	1	1755.135	-44.84	-13	Pass
1756	1775	1	CHP	2	1762.757	-36.45	-13	Pass

Band4_20MHz_QPSK_HCH_1745MHz_RB_100_0_NTNV

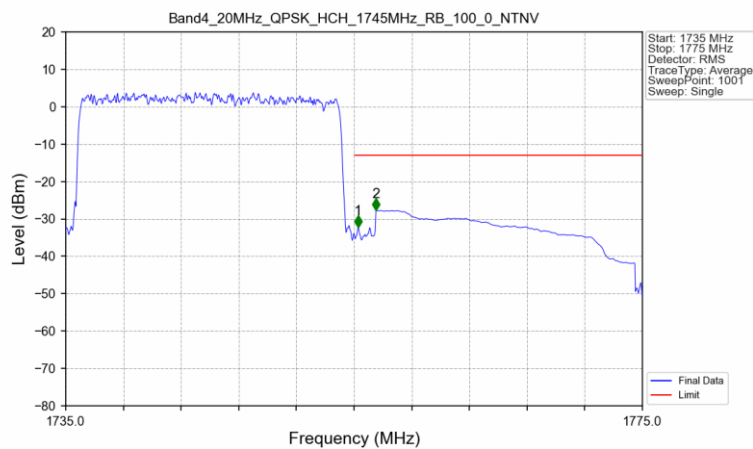

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
1735	1755	0.2	/	/	/	/	/	/
1755	1756	0.2	/	1	1755.280	-32.20	-13	Pass
1756	1775	1	CHP	2	1756.520	-27.61	-13	Pass

- End of the Appendix -