



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant2	5650	-48.84	6.43	-42.41	Peak	-27	Pass
NVNT	a	5745	Ant2	5650	-56.25	6.43	-49.82	Average	-27	Pass
NVNT	a	5745	Ant2	5700	-47.98	6.43	-41.55	Peak	10	Pass
NVNT	a	5745	Ant2	5700	-56.13	6.43	-49.70	Average	10	Pass
NVNT	a	5745	Ant2	5720	-49.16	6.43	-42.73	Peak	15.6	Pass
NVNT	a	5745	Ant2	5720	-55.93	6.43	-49.50	Average	15.6	Pass
NVNT	a	5745	Ant2	5725	-48.6	6.43	-42.17	Peak	27	Pass
NVNT	a	5745	Ant2	5725	-54.54	6.43	-48.11	Average	27	Pass
NVNT	a	5825	Ant2	5850	-50.42	6.43	-43.99	Peak	27	Pass
NVNT	a	5825	Ant2	5850	-56.71	6.43	-50.28	Average	27	Pass
NVNT	a	5825	Ant2	5855	-49.66	6.43	-43.23	Peak	15.6	Pass
NVNT	a	5825	Ant2	5855	-56.87	6.43	-50.44	Average	15.6	Pass
NVNT	a	5825	Ant2	5875	-49.93	6.43	-43.50	Peak	10	Pass
NVNT	a	5825	Ant2	5875	-56.86	6.43	-50.43	Average	10	Pass
NVNT	a	5825	Ant2	5925	-46.96	6.43	-40.53	Peak	-27	Pass
NVNT	a	5825	Ant2	5925	-56.43	6.43	-50.00	Average	-27	Pass
NVNT	n20	5745	Ant2	5650	-49.25	6.43	-42.82	Peak	-27	Pass
NVNT	n20	5745	Ant2	5650	-56.27	6.43	-49.84	Average	-27	Pass
NVNT	n20	5745	Ant2	5700	-47.86	6.43	-41.43	Peak	10	Pass
NVNT	n20	5745	Ant2	5700	-56.38	6.43	-49.95	Average	10	Pass
NVNT	n20	5745	Ant2	5720	-47.79	6.43	-41.36	Peak	15.6	Pass
NVNT	n20	5745	Ant2	5720	-55.99	6.43	-49.56	Average	15.6	Pass
NVNT	n20	5745	Ant2	5725	-46.74	6.43	-40.31	Peak	27	Pass
NVNT	n20	5745	Ant2	5725	-55	6.43	-48.57	Average	27	Pass
NVNT	n20	5825	Ant2	5850	-50.64	6.43	-44.21	Peak	27	Pass
NVNT	n20	5825	Ant2	5850	-56.69	6.43	-50.26	Average	27	Pass
NVNT	n20	5825	Ant2	5855	-50.12	6.43	-43.69	Peak	15.6	Pass
NVNT	n20	5825	Ant2	5855	-56.72	6.43	-50.29	Average	15.6	Pass
NVNT	n20	5825	Ant2	5875	-49.98	6.43	-43.55	Peak	10	Pass
NVNT	n20	5825	Ant2	5875	-56.52	6.43	-50.09	Average	10	Pass
NVNT	n20	5825	Ant2	5925	-50.6	6.43	-44.17	Peak	-27	Pass
NVNT	n20	5825	Ant2	5925	-56.14	6.43	-49.71	Average	-27	Pass
NVNT	n40	5755	Ant2	5650	-49.49	6.43	-43.06	Peak	-27	Pass
NVNT	n40	5755	Ant2	5650	-56.33	6.43	-49.90	Average	-27	Pass
NVNT	n40	5755	Ant2	5700	-50.34	6.43	-43.91	Peak	10	Pass
NVNT	n40	5755	Ant2	5700	-56.05	6.43	-49.62	Average	10	Pass
NVNT	n40	5755	Ant2	5720	-49.03	6.43	-42.60	Peak	15.6	Pass
NVNT	n40	5755	Ant2	5720	-55.53	6.43	-49.10	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	n40	5755	Ant2	5725	-46.18	6.43	-39.75	Peak	27	Pass
NVNT	n40	5755	Ant2	5725	-53.1	6.43	-46.67	Average	27	Pass
NVNT	n40	5795	Ant2	5850	-51.11	6.43	-44.68	Peak	27	Pass
NVNT	n40	5795	Ant2	5850	-56.77	6.43	-50.34	Average	27	Pass
NVNT	n40	5795	Ant2	5855	-50.01	6.43	-43.58	Peak	15.6	Pass
NVNT	n40	5795	Ant2	5855	-57.07	6.43	-50.64	Average	15.6	Pass
NVNT	n40	5795	Ant2	5875	-50.24	6.43	-43.81	Peak	10	Pass
NVNT	n40	5795	Ant2	5875	-56.82	6.43	-50.39	Average	10	Pass
NVNT	n40	5795	Ant2	5925	-50.94	6.43	-44.51	Peak	-27	Pass
NVNT	n40	5795	Ant2	5925	-56.35	6.43	-49.92	Average	-27	Pass
NVNT	ac20	5745	Ant2	5650	-49.43	6.43	-43.00	Peak	-27	Pass
NVNT	ac20	5745	Ant2	5650	-56.42	6.43	-49.99	Average	-27	Pass
NVNT	ac20	5745	Ant2	5700	-48.92	6.43	-42.49	Peak	10	Pass
NVNT	ac20	5745	Ant2	5700	-56.33	6.43	-49.90	Average	10	Pass
NVNT	ac20	5745	Ant2	5720	-50.03	6.43	-43.60	Peak	15.6	Pass
NVNT	ac20	5745	Ant2	5720	-56.15	6.43	-49.72	Average	15.6	Pass
NVNT	ac20	5745	Ant2	5725	-47.54	6.43	-41.11	Peak	27	Pass
NVNT	ac20	5745	Ant2	5725	-55.54	6.43	-49.11	Average	27	Pass
NVNT	ac20	5825	Ant2	5850	-49.94	6.43	-43.51	Peak	27	Pass
NVNT	ac20	5825	Ant2	5850	-56.89	6.43	-50.46	Average	27	Pass
NVNT	ac20	5825	Ant2	5855	-49.99	6.43	-43.56	Peak	15.6	Pass
NVNT	ac20	5825	Ant2	5855	-57.11	6.43	-50.68	Average	15.6	Pass
NVNT	ac20	5825	Ant2	5875	-49.08	6.43	-42.65	Peak	10	Pass
NVNT	ac20	5825	Ant2	5875	-56.78	6.43	-50.35	Average	10	Pass
NVNT	ac20	5825	Ant2	5925	-47.15	6.43	-40.72	Peak	-27	Pass
NVNT	ac20	5825	Ant2	5925	-56.26	6.43	-49.83	Average	-27	Pass
NVNT	ac40	5755	Ant2	5650	-49.41	6.43	-42.98	Peak	-27	Pass
NVNT	ac40	5755	Ant2	5650	-56.28	6.43	-49.85	Average	-27	Pass
NVNT	ac40	5755	Ant2	5700	-48.68	6.43	-42.25	Peak	10	Pass
NVNT	ac40	5755	Ant2	5700	-55.93	6.43	-49.50	Average	10	Pass
NVNT	ac40	5755	Ant2	5720	-49.05	6.43	-42.62	Peak	15.6	Pass
NVNT	ac40	5755	Ant2	5720	-55.52	6.43	-49.09	Average	15.6	Pass
NVNT	ac40	5755	Ant2	5725	-46.79	6.43	-40.36	Peak	27	Pass
NVNT	ac40	5755	Ant2	5725	-53.04	6.43	-46.61	Average	27	Pass
NVNT	ac40	5795	Ant2	5850	-51.14	6.43	-44.71	Peak	27	Pass
NVNT	ac40	5795	Ant2	5850	-57.16	6.43	-50.73	Average	27	Pass
NVNT	ac40	5795	Ant2	5855	-50.43	6.43	-44.00	Peak	15.6	Pass
NVNT	ac40	5795	Ant2	5855	-57.12	6.43	-50.69	Average	15.6	Pass
NVNT	ac40	5795	Ant2	5875	-50.23	6.43	-43.80	Peak	10	Pass
NVNT	ac40	5795	Ant2	5875	-56.54	6.43	-50.11	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac40	5795	Ant2	5925	-49.69	6.43	-43.26	Peak	-27	Pass
NVNT	ac40	5795	Ant2	5925	-56.26	6.43	-49.83	Average	-27	Pass
NVNT	ac80	5775	Ant2	5850	-49.74	6.43	-43.31	Peak	27	Pass
NVNT	ac80	5775	Ant2	5850	-56.1	6.43	-49.67	Average	27	Pass
NVNT	ac80	5775	Ant2	5855	-51.2	6.43	-44.77	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5855	-55.95	6.43	-49.52	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5875	-50.39	6.43	-43.96	Peak	10	Pass
NVNT	ac80	5775	Ant2	5875	-55.78	6.43	-49.35	Average	10	Pass
NVNT	ac80	5775	Ant2	5925	-48.52	6.43	-42.09	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5925	-55.36	6.43	-48.93	Average	-27	Pass
NVNT	ac80	5775	Ant2	5650	-48.8	6.43	-42.37	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5650	-55.74	6.43	-49.31	Average	-27	Pass
NVNT	ac80	5775	Ant2	5700	-48.16	6.43	-41.73	Peak	10	Pass
NVNT	ac80	5775	Ant2	5700	-54.91	6.43	-48.48	Average	10	Pass
NVNT	ac80	5775	Ant2	5720	-45.99	6.43	-39.56	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5720	-54.02	6.43	-47.59	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5725	-47.69	6.43	-41.26	Peak	27	Pass
NVNT	ac80	5775	Ant2	5725	-51.8	6.43	-45.37	Average	27	Pass
NVNT	ax20	5745	Ant2	5650	-49.5	6.43	-43.07	Peak	-27	Pass
NVNT	ax20	5745	Ant2	5650	-56.32	6.43	-49.89	Average	-27	Pass
NVNT	ax20	5745	Ant2	5700	-50.12	6.43	-43.69	Peak	10	Pass
NVNT	ax20	5745	Ant2	5700	-56.38	6.43	-49.95	Average	10	Pass
NVNT	ax20	5745	Ant2	5720	-48.8	6.43	-42.37	Peak	15.6	Pass
NVNT	ax20	5745	Ant2	5720	-56.22	6.43	-49.79	Average	15.6	Pass
NVNT	ax20	5745	Ant2	5725	-49.49	6.43	-43.06	Peak	27	Pass
NVNT	ax20	5745	Ant2	5725	-55.42	6.43	-48.99	Average	27	Pass
NVNT	ax20	5825	Ant2	5850	-50.45	6.43	-44.02	Peak	27	Pass
NVNT	ax20	5825	Ant2	5850	-56.92	6.43	-50.49	Average	27	Pass
NVNT	ax20	5825	Ant2	5855	-49.13	6.43	-42.70	Peak	15.6	Pass
NVNT	ax20	5825	Ant2	5855	-56.95	6.43	-50.52	Average	15.6	Pass
NVNT	ax20	5825	Ant2	5875	-51.19	6.43	-44.76	Peak	10	Pass
NVNT	ax20	5825	Ant2	5875	-56.84	6.43	-50.41	Average	10	Pass
NVNT	ax20	5825	Ant2	5925	-49.67	6.43	-43.24	Peak	-27	Pass
NVNT	ax20	5825	Ant2	5925	-56.25	6.43	-49.82	Average	-27	Pass
NVNT	ax40	5755	Ant2	5650	-47.97	6.43	-41.54	Peak	-27	Pass
NVNT	ax40	5755	Ant2	5650	-56.14	6.43	-49.71	Average	-27	Pass
NVNT	ax40	5755	Ant2	5700	-49.94	6.43	-43.51	Peak	10	Pass
NVNT	ax40	5755	Ant2	5700	-56.37	6.43	-49.94	Average	10	Pass
NVNT	ax40	5755	Ant2	5720	-49.16	6.43	-42.73	Peak	15.6	Pass
NVNT	ax40	5755	Ant2	5720	-56.23	6.43	-49.80	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ax40	5755	Ant2	5725	-50.55	6.43	-44.12	Peak	27	Pass
NVNT	ax40	5755	Ant2	5725	-56.16	6.43	-49.73	Average	27	Pass
NVNT	ax40	5795	Ant2	5850	-48.99	6.43	-42.56	Peak	27	Pass
NVNT	ax40	5795	Ant2	5850	-56.94	6.43	-50.51	Average	27	Pass
NVNT	ax40	5795	Ant2	5855	-49.15	6.43	-42.72	Peak	15.6	Pass
NVNT	ax40	5795	Ant2	5855	-57.07	6.43	-50.64	Average	15.6	Pass
NVNT	ax40	5795	Ant2	5875	-51.26	6.43	-44.83	Peak	10	Pass
NVNT	ax40	5795	Ant2	5875	-56.4	6.43	-49.97	Average	10	Pass
NVNT	ax40	5795	Ant2	5925	-49.73	6.43	-43.30	Peak	-27	Pass
NVNT	ax40	5795	Ant2	5925	-56.44	6.43	-50.01	Average	-27	Pass
NVNT	ax80	5775	Ant2	5850	-51.17	6.43	-44.74	Peak	27	Pass
NVNT	ax80	5775	Ant2	5850	-55.65	6.43	-49.22	Average	27	Pass
NVNT	ax80	5775	Ant2	5855	-48.46	6.43	-42.03	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5855	-54.67	6.43	-48.24	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5875	-49.75	6.43	-43.32	Peak	10	Pass
NVNT	ax80	5775	Ant2	5875	-55.61	6.43	-49.18	Average	10	Pass
NVNT	ax80	5775	Ant2	5925	-50.2	6.43	-43.77	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5925	-55.69	6.43	-49.26	Average	-27	Pass
NVNT	ax80	5775	Ant2	5650	-48.88	6.43	-42.45	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5650	-55.49	6.43	-49.06	Average	-27	Pass
NVNT	ax80	5775	Ant2	5700	-48.09	6.43	-41.66	Peak	10	Pass
NVNT	ax80	5775	Ant2	5700	-54.43	6.43	-48.00	Average	10	Pass
NVNT	ax80	5775	Ant2	5720	-46.59	6.43	-40.16	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5720	-53.72	6.43	-47.29	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5725	-46.49	6.43	-40.06	Peak	27	Pass
NVNT	ax80	5775	Ant2	5725	-52.35	6.43	-45.92	Average	27	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5745MHz Ant2 Peak

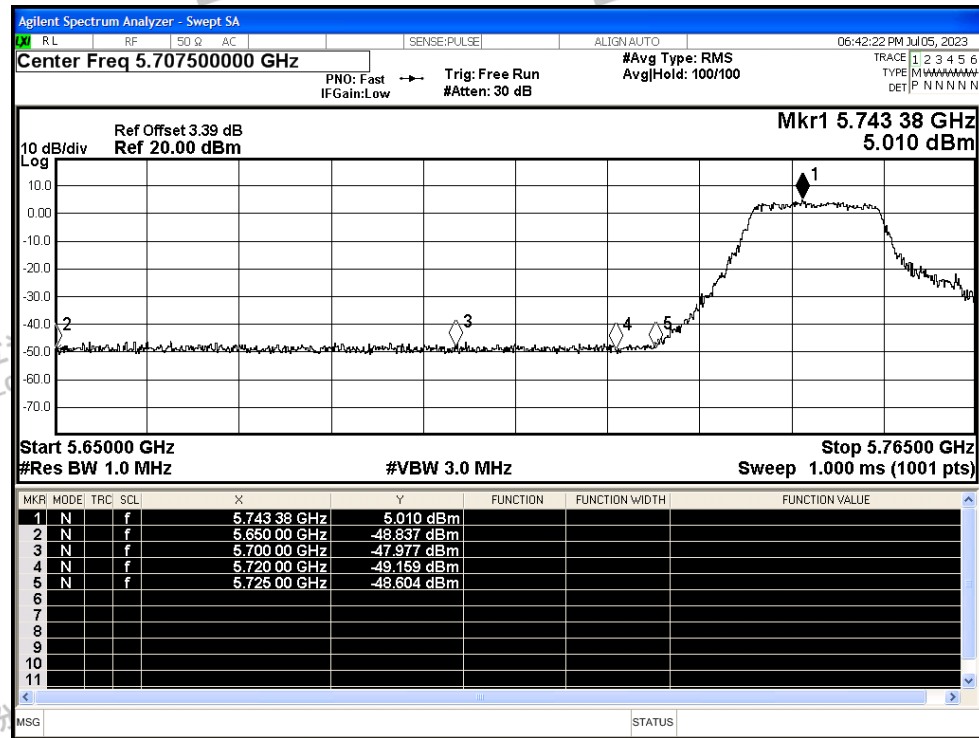

Restrict Band NVNT a 5745MHz Ant2 Average

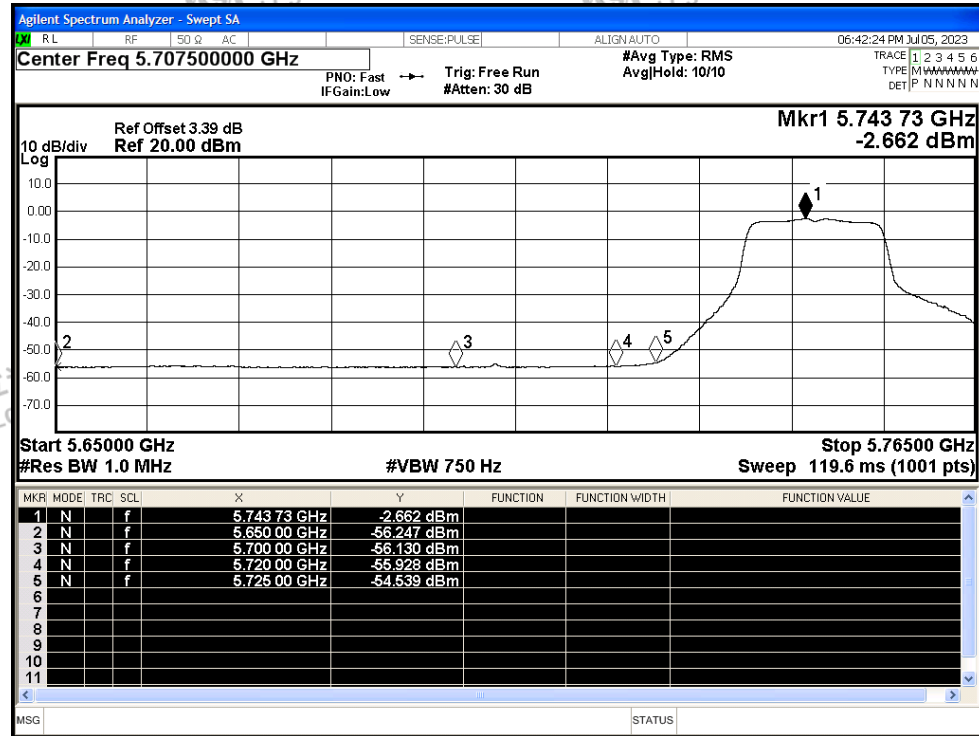

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant2 Peak

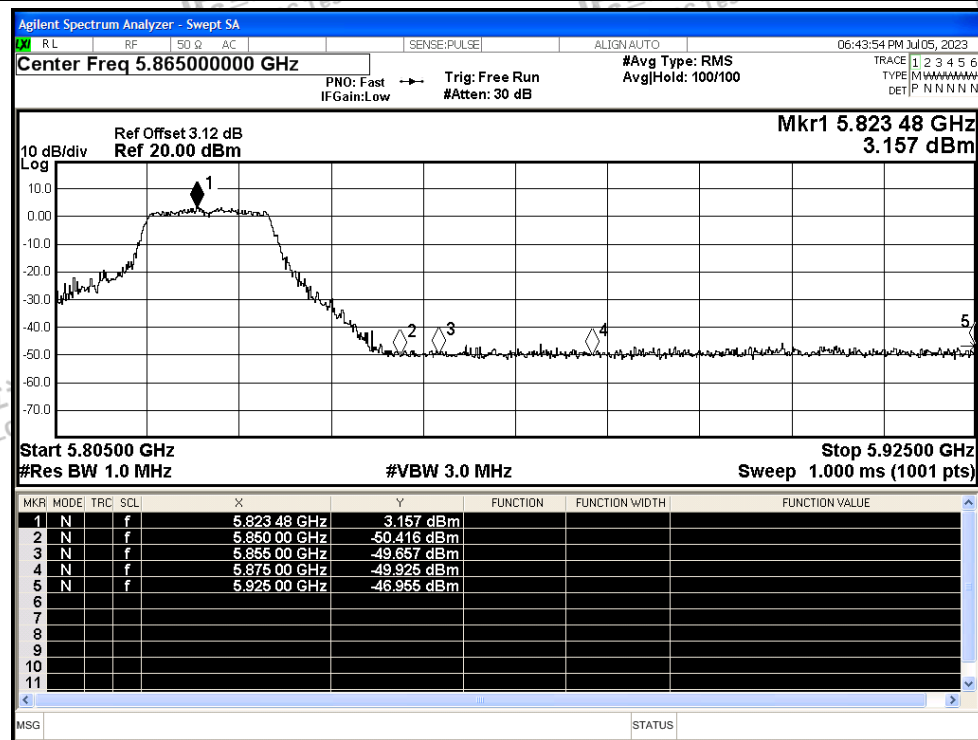


Restrict Band NVNT a 5825MHz Ant2 Average

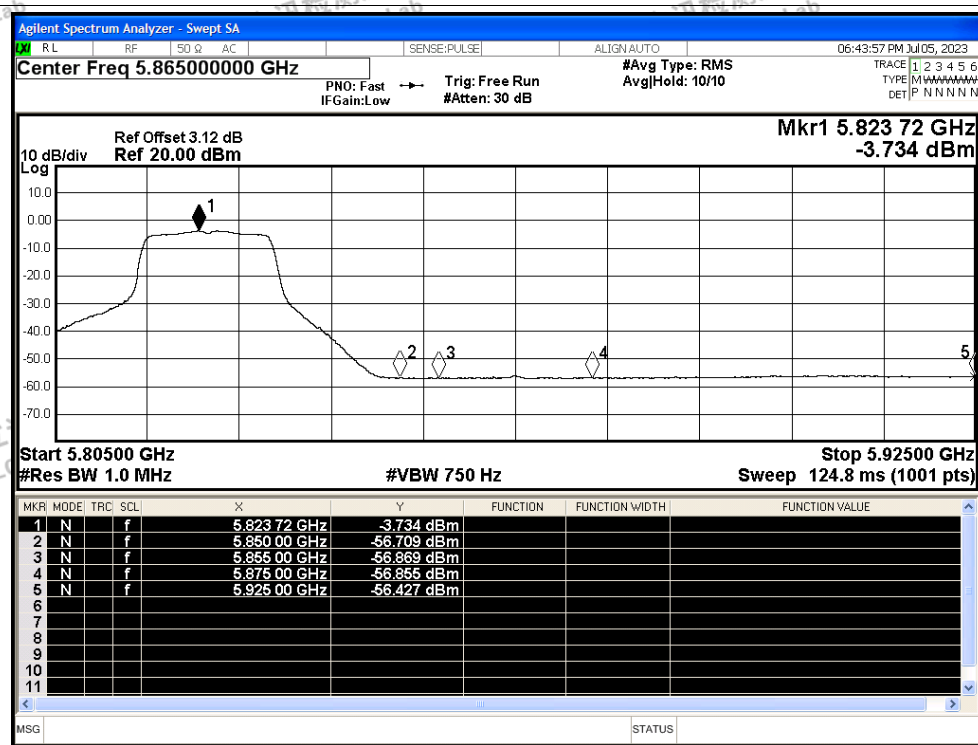




Restrict Band NVNT n20 5745MHz Ant2 Peak

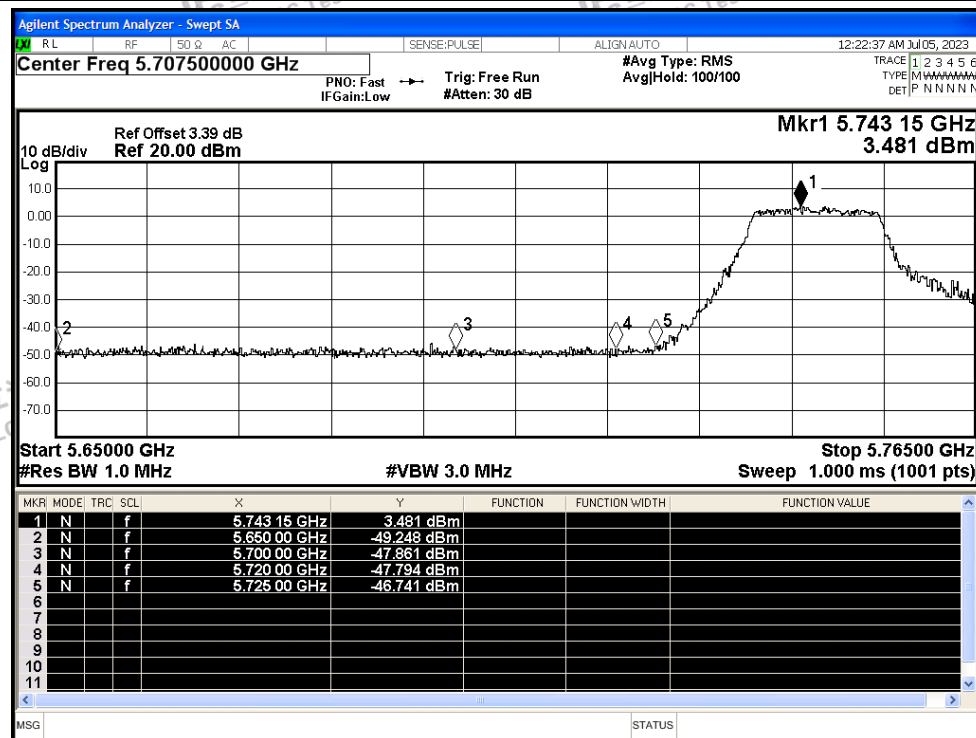


Restrict Band NVNT n20 5745MHz Ant2 Average

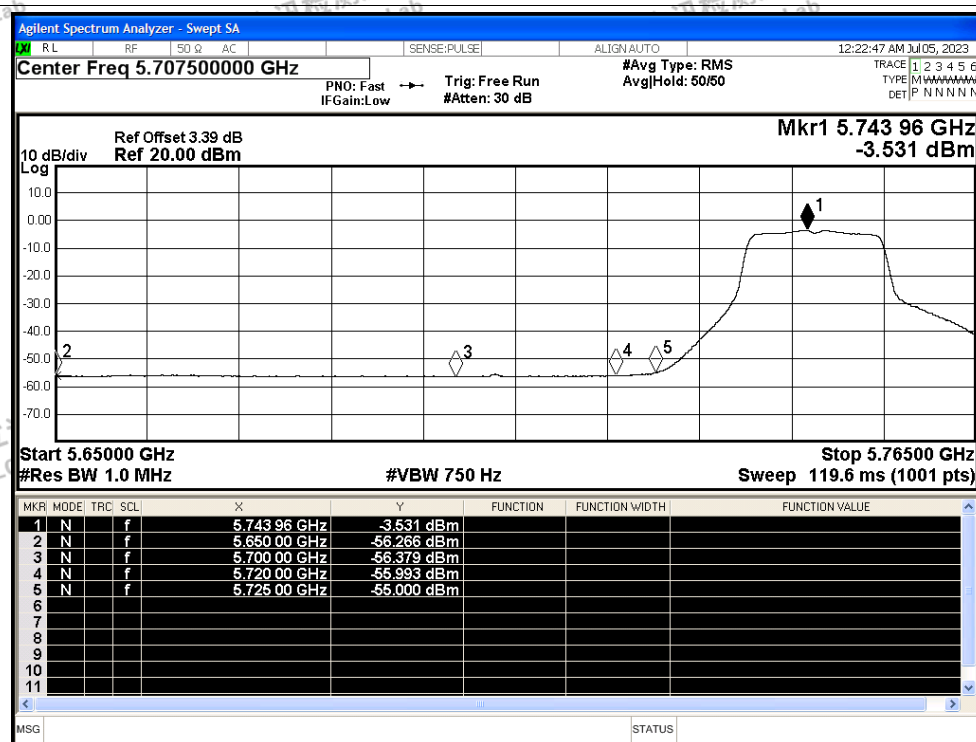




Restrict Band NVNT n20 5825MHz Ant2 Peak

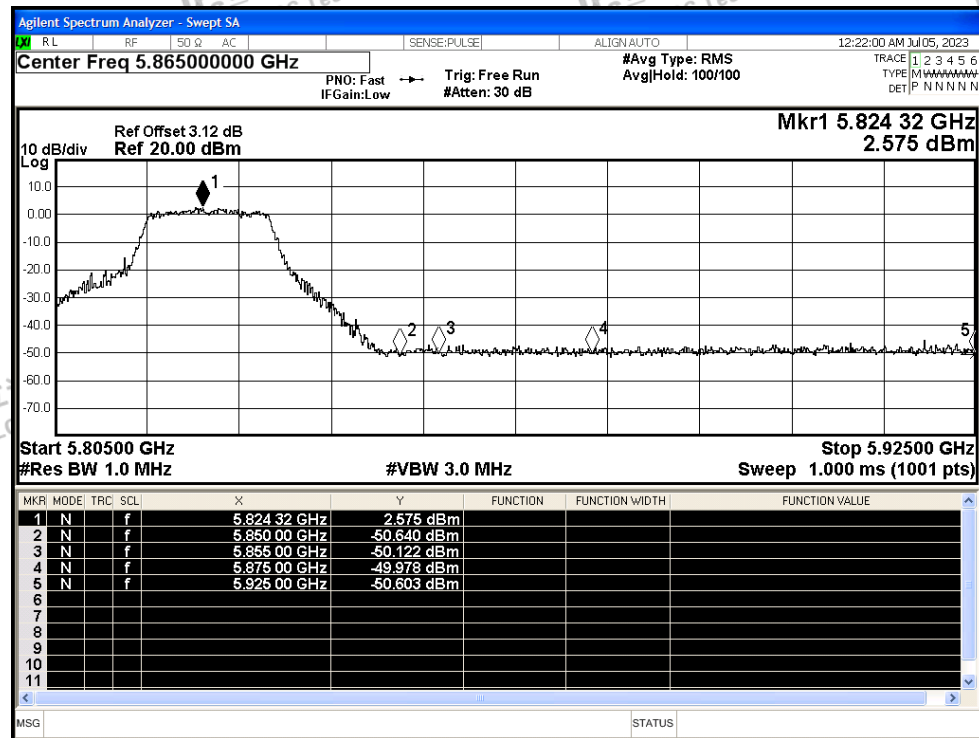


Restrict Band NVNT n20 5825MHz Ant2 Average

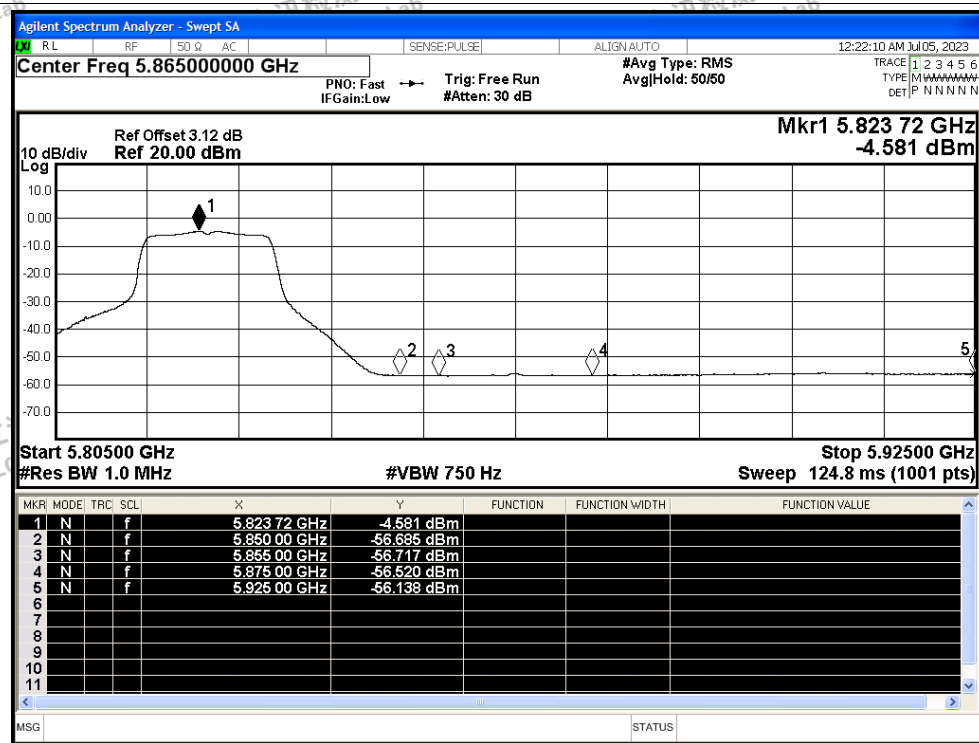




Restrict Band NVNT n40 5755MHz Ant2 Peak

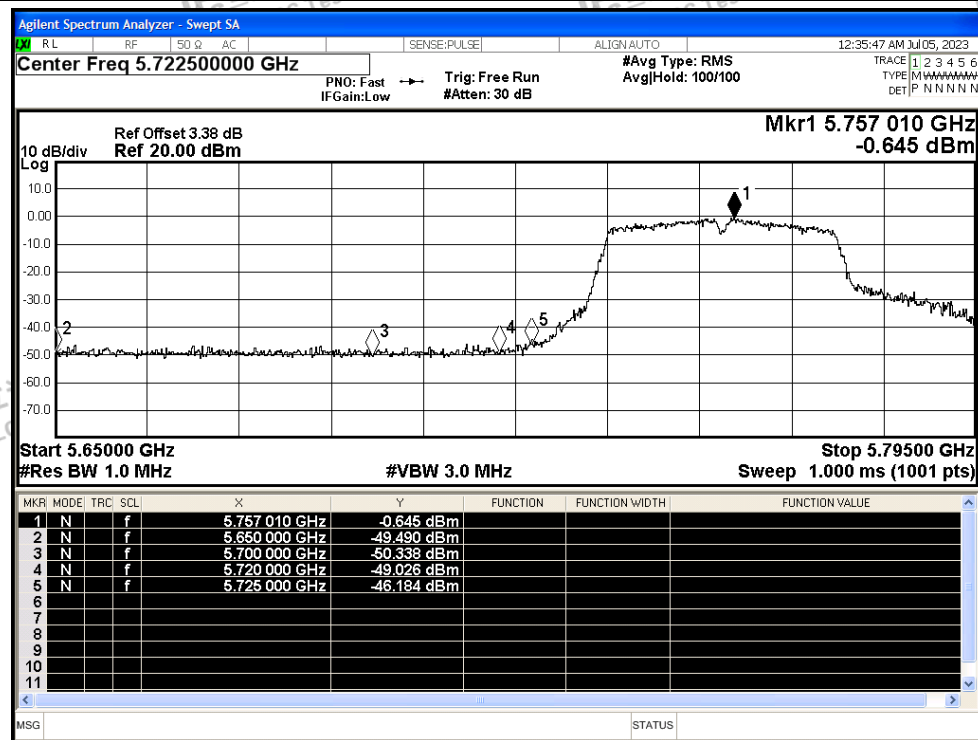

Restrict Band NVNT n40 5755MHz Ant2 Average

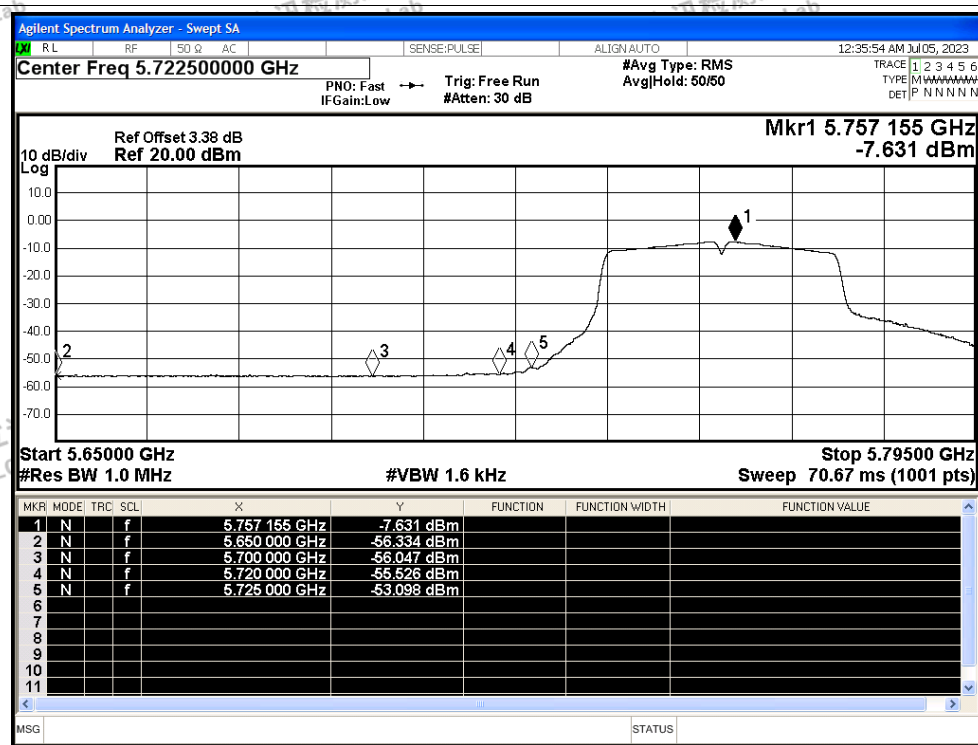

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity





Restrict Band NVNT n40 5795MHz Ant2 Peak

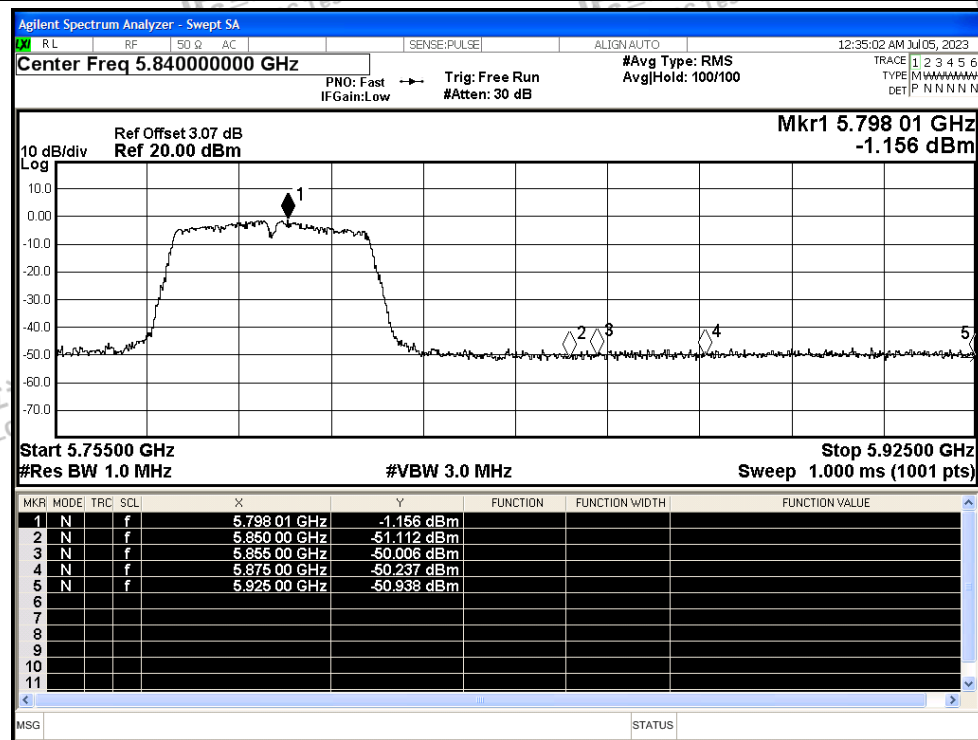


Restrict Band NVNT n40 5795MHz Ant2 Average

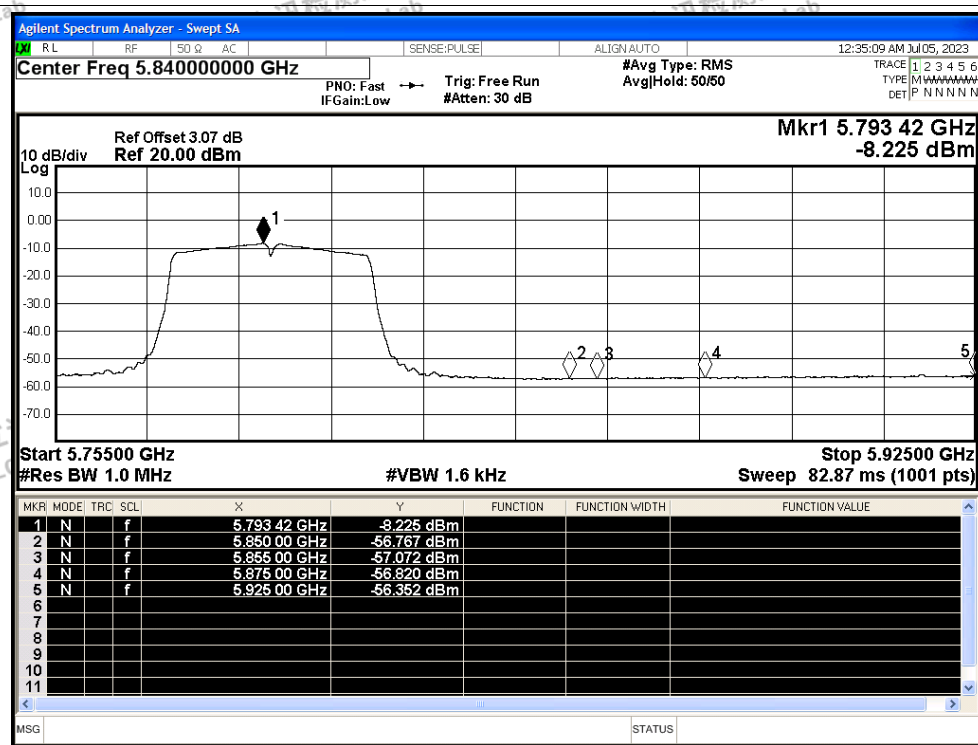

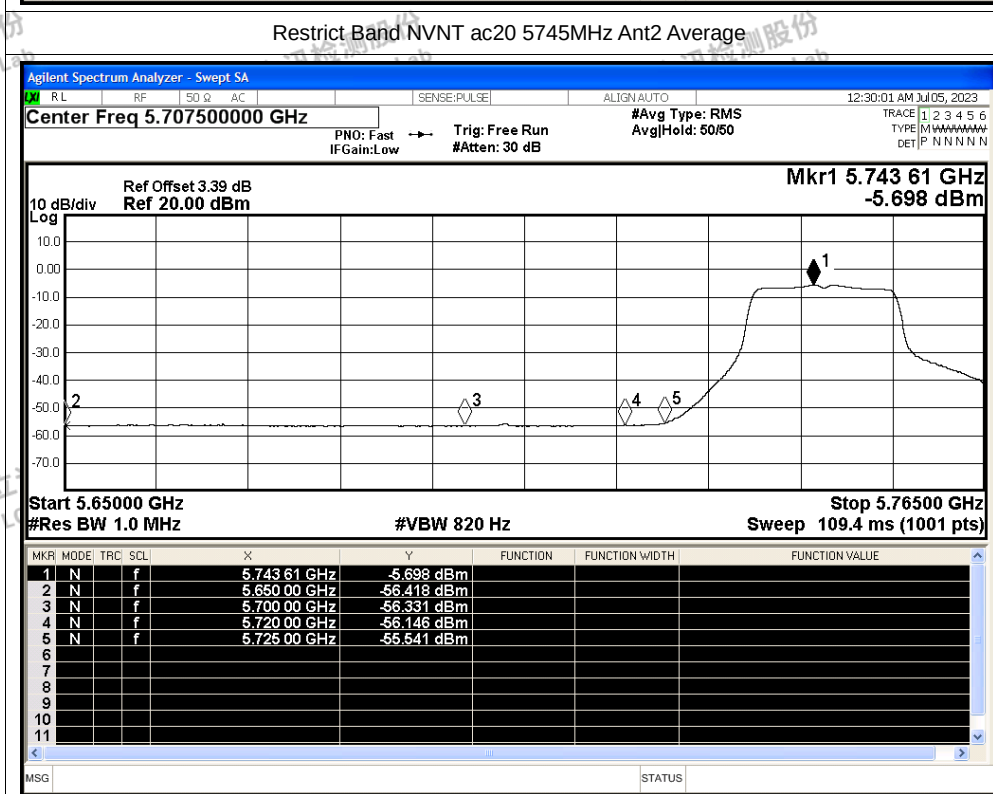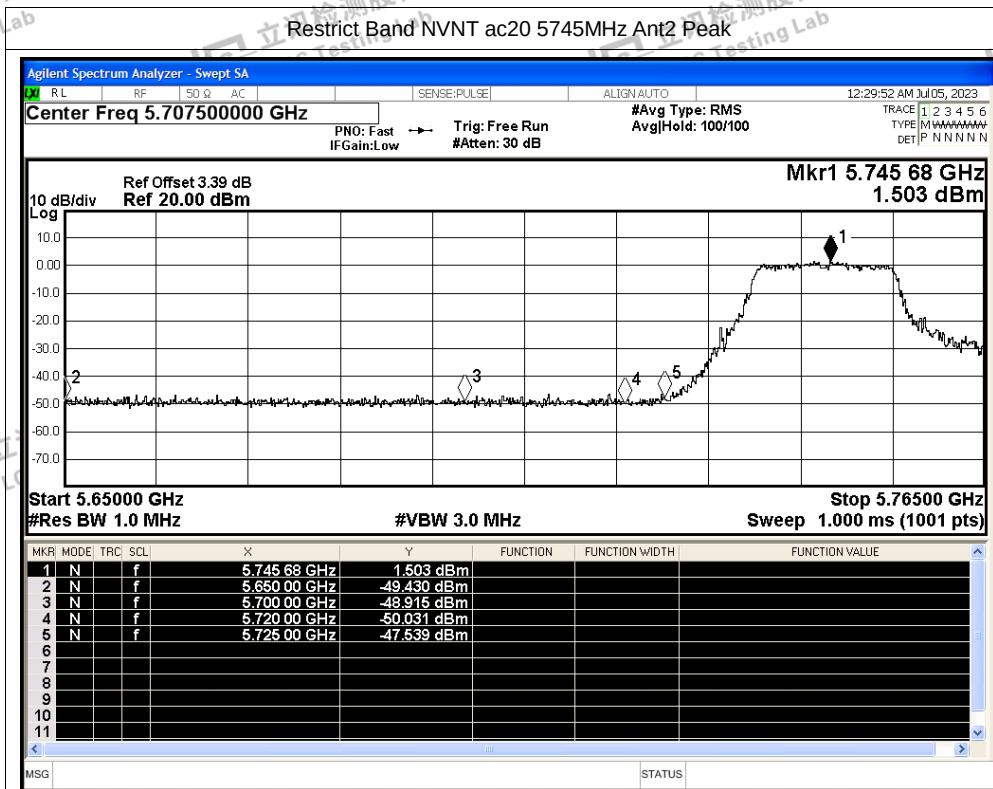





Restrict Band NVNT ac20 5825MHz Ant2 Peak

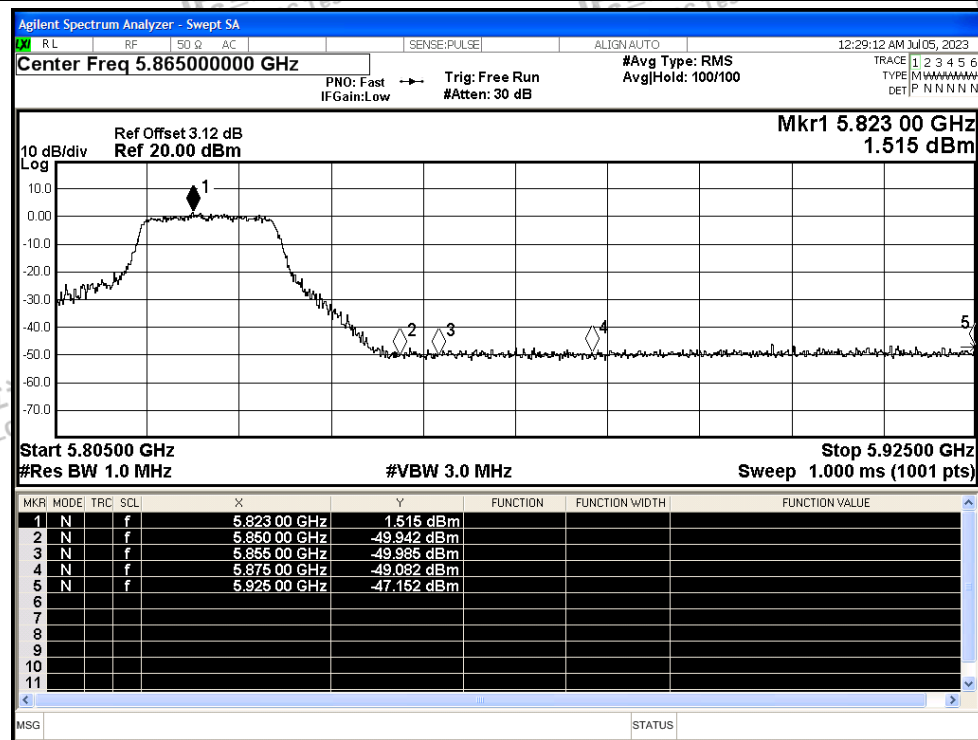


Restrict Band NVNT ac20 5825MHz Ant2 Average

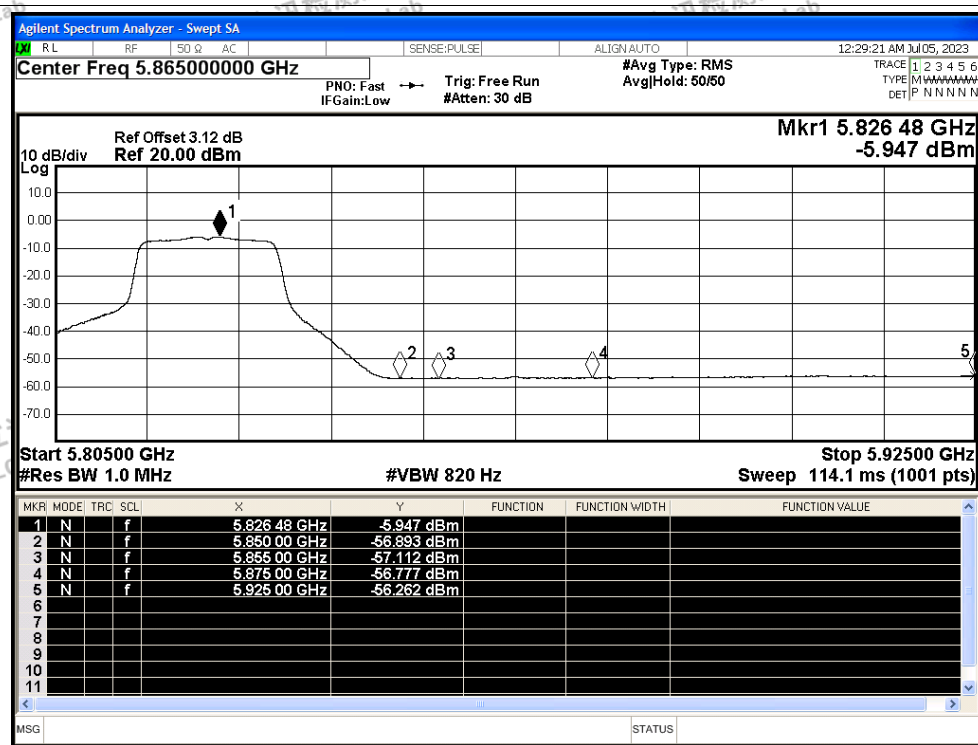

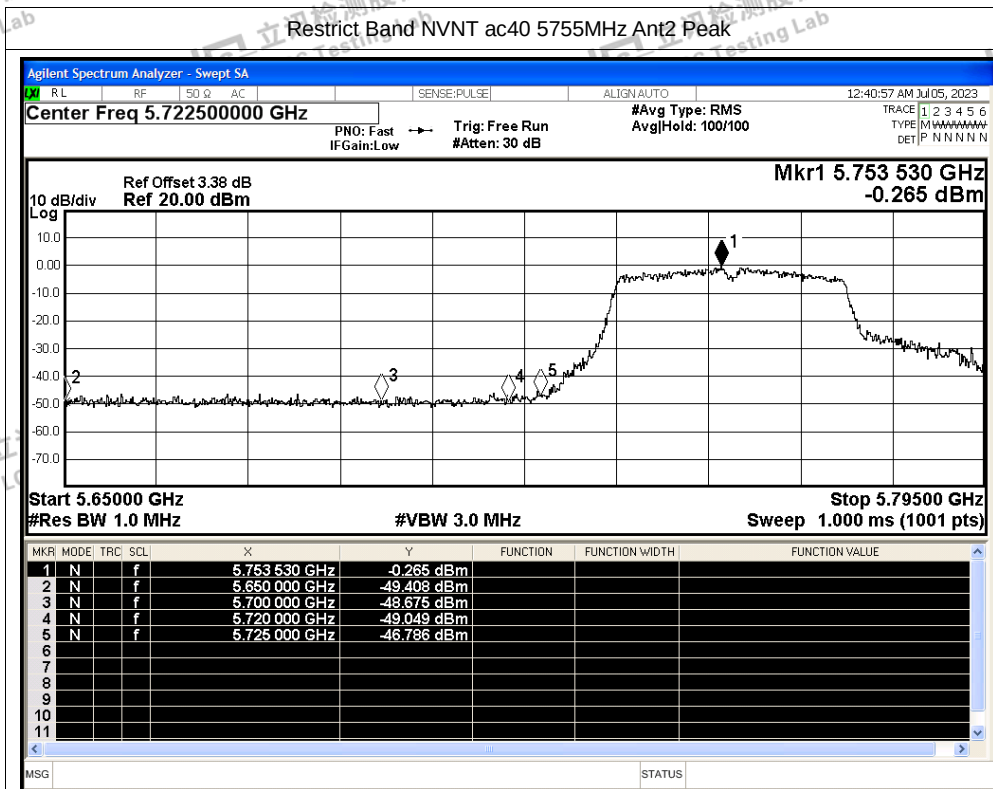


Restrict Band NVNT ac40 5755MHz Ant2 Average

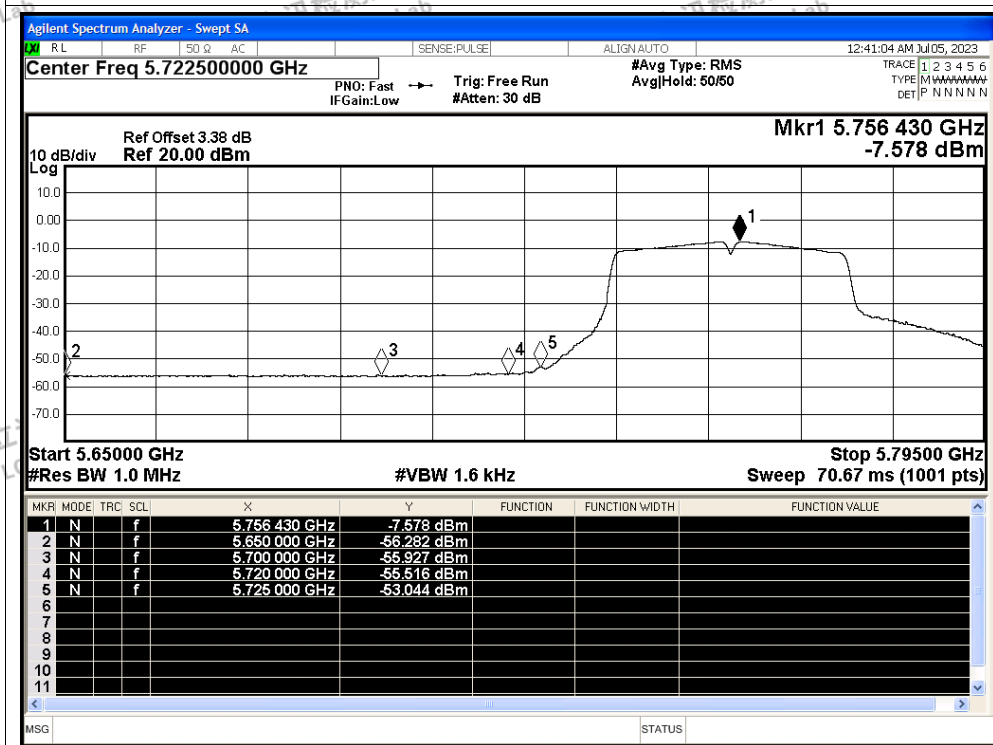




Restrict Band NVNT ac40 5795MHz Ant2 Peak

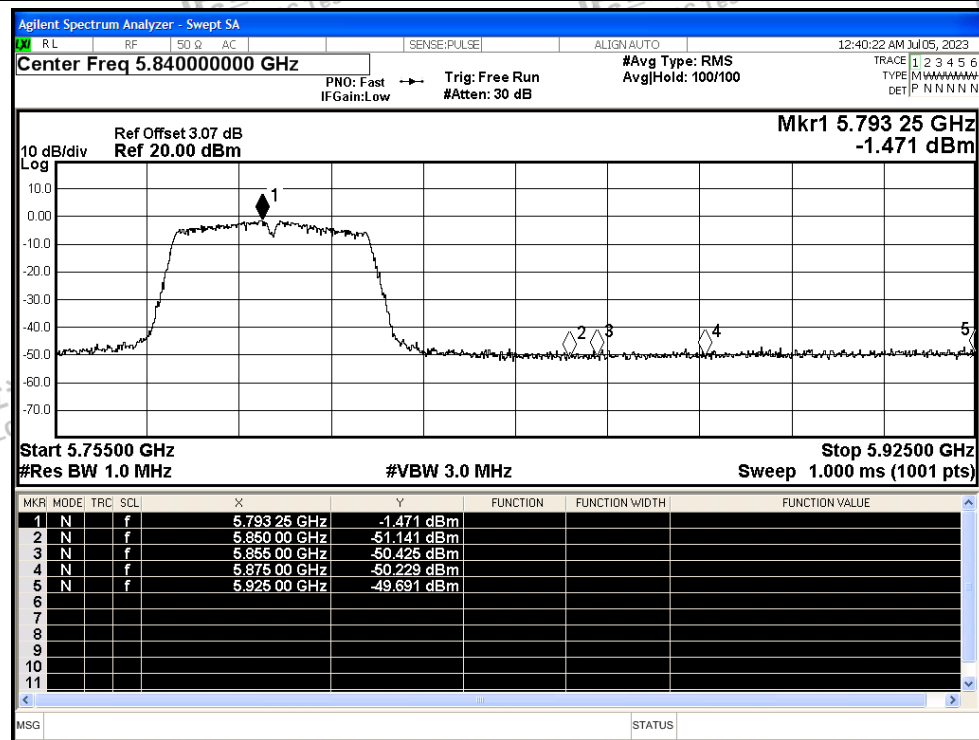

Restrict Band NVNT ac40 5795MHz Ant2 Average

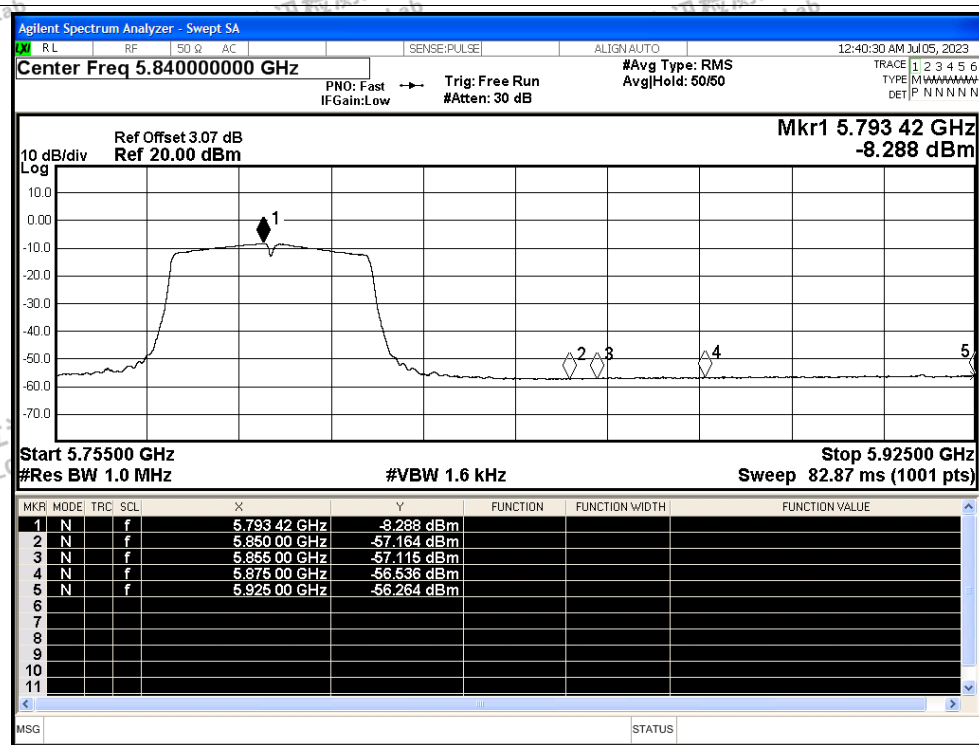

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity





Restrict Band NVNT ac80 5775MHz Ant2 Peak

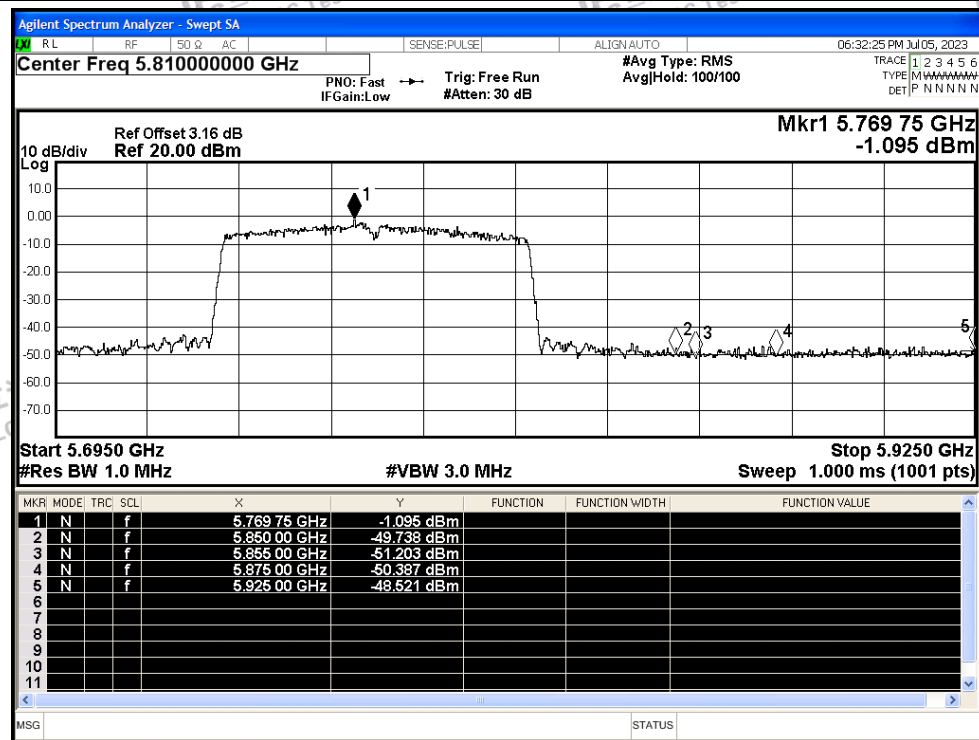


Restrict Band NVNT ac80 5775MHz Ant2 Average

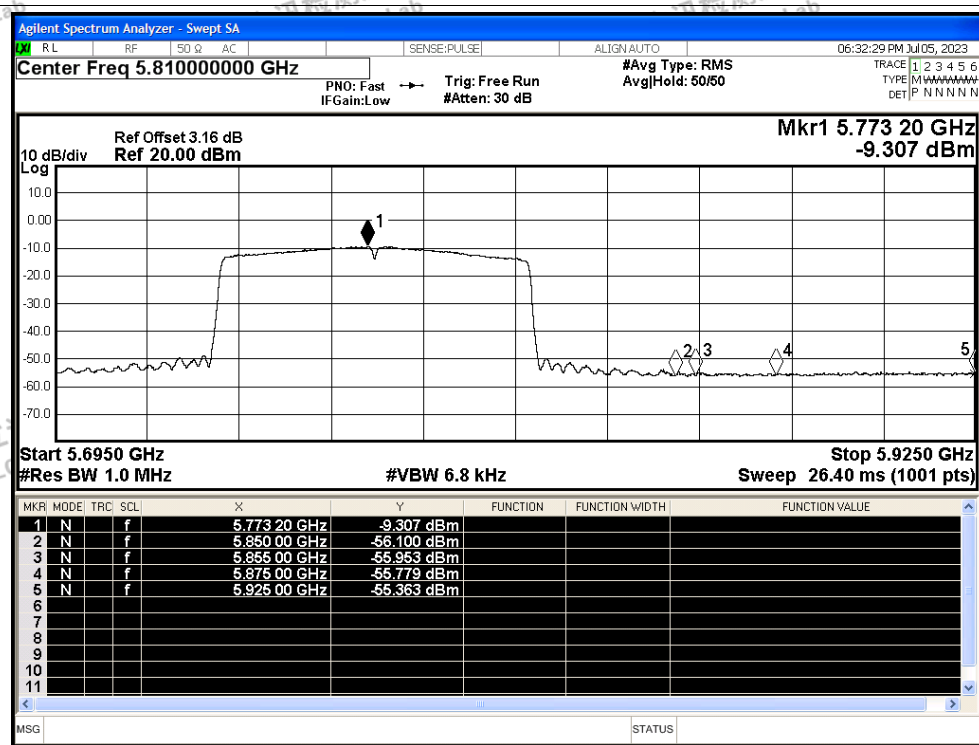

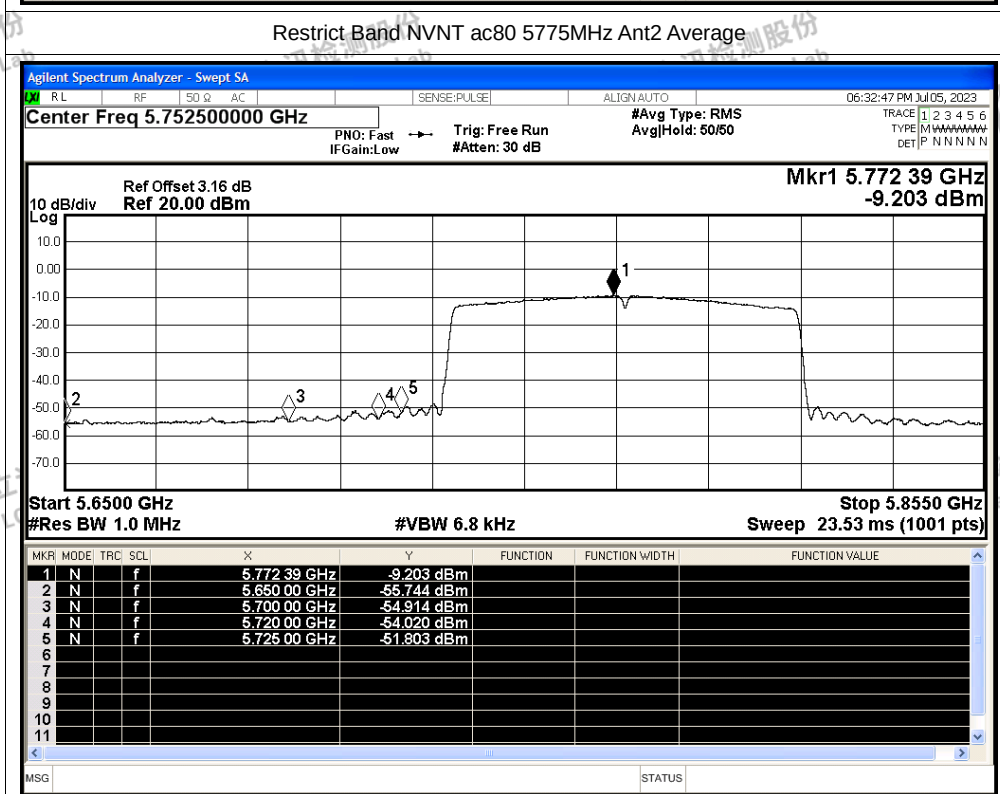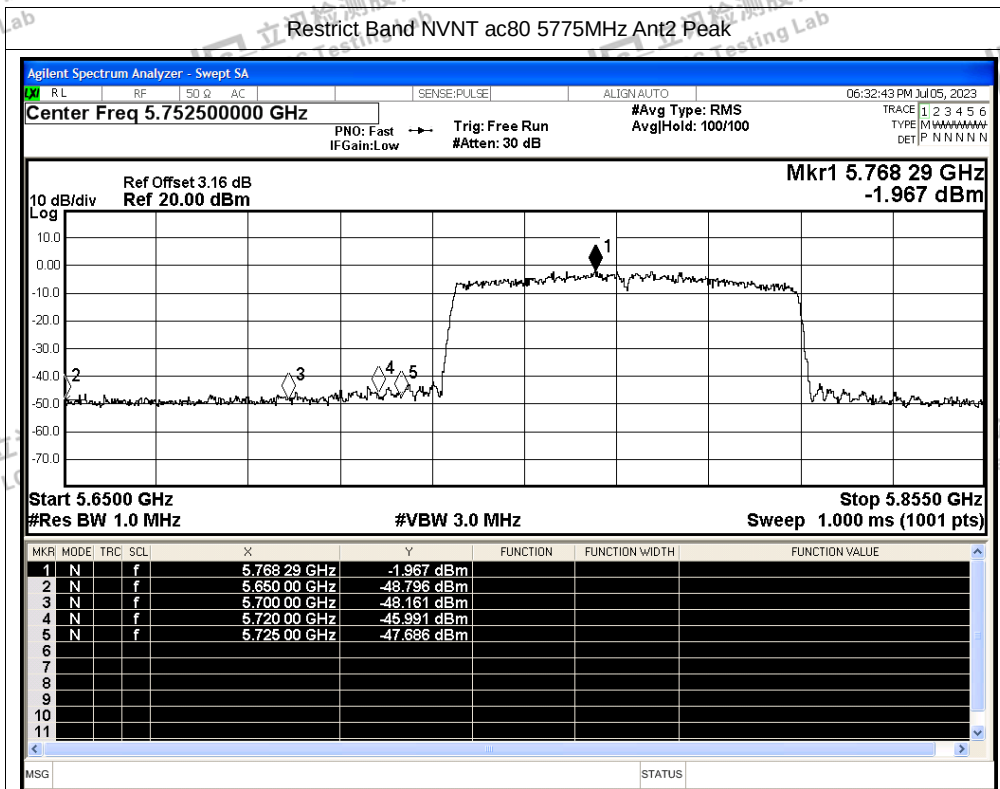




Restrict Band NVNT ax20 5745MHz Ant2 Peak

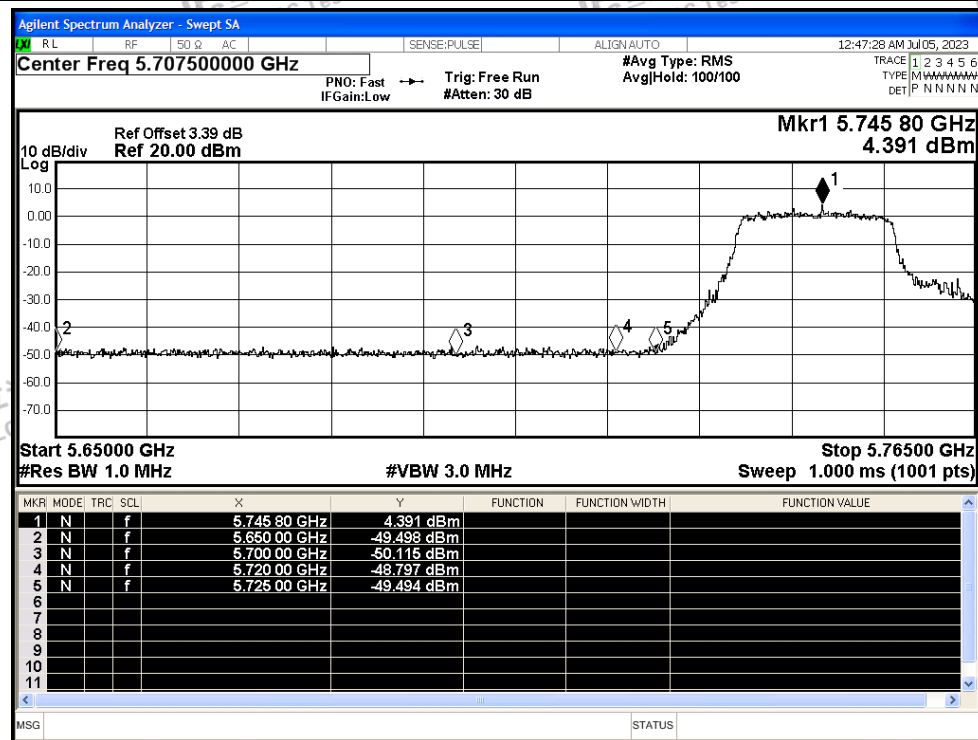


Restrict Band NVNT ax20 5745MHz Ant2 Average

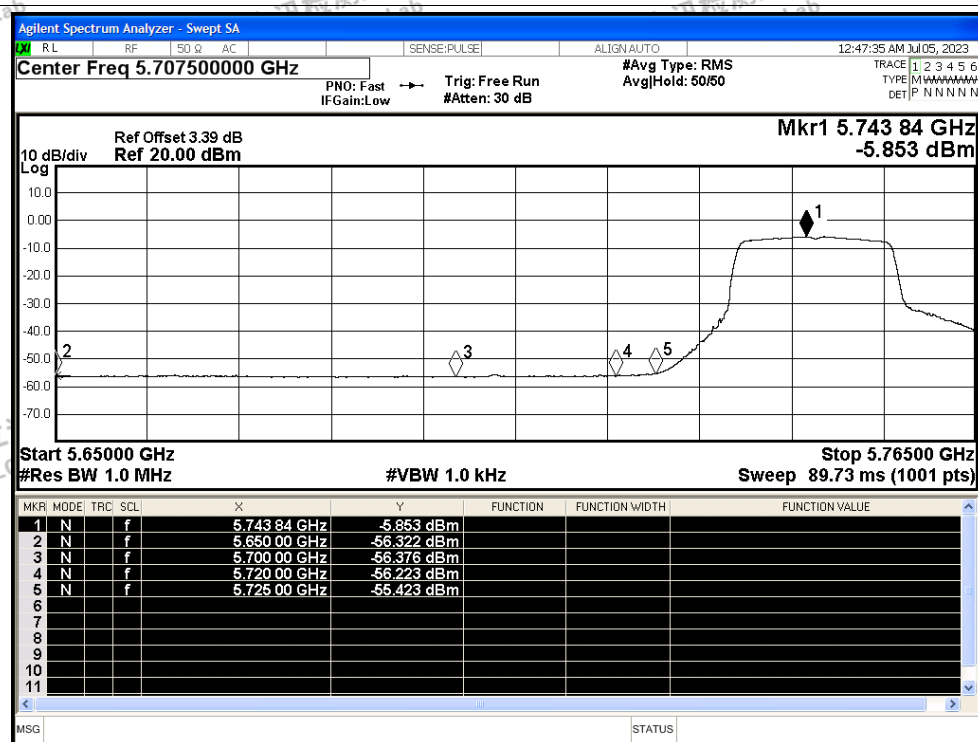




Restrict Band NVNT ax20 5825MHz Ant2 Peak

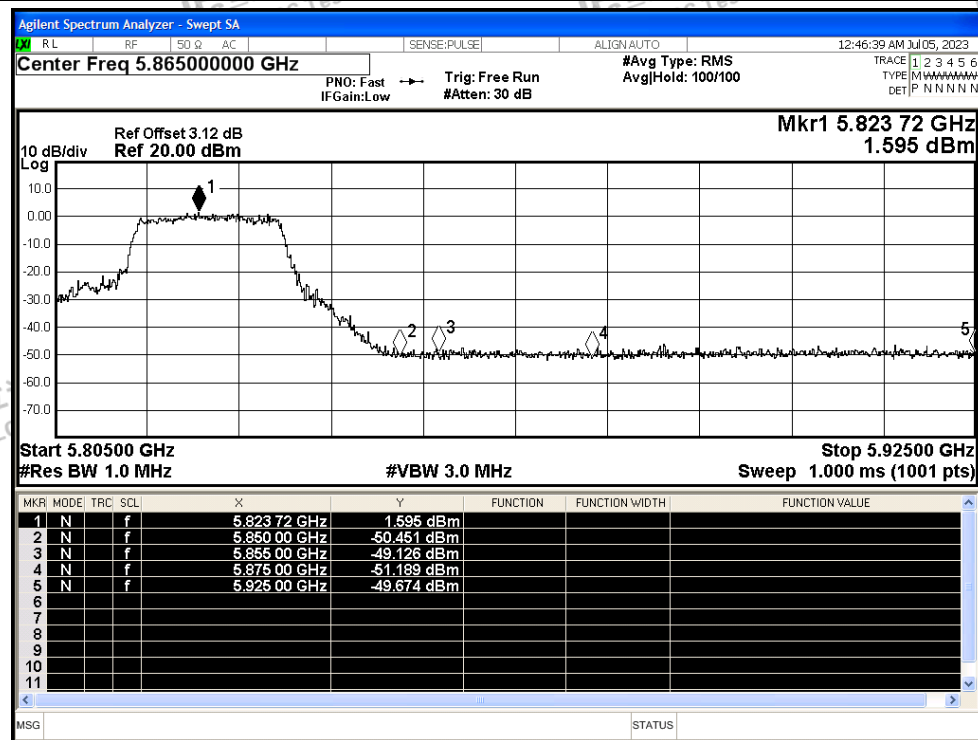


Restrict Band NVNT ax20 5825MHz Ant2 Average

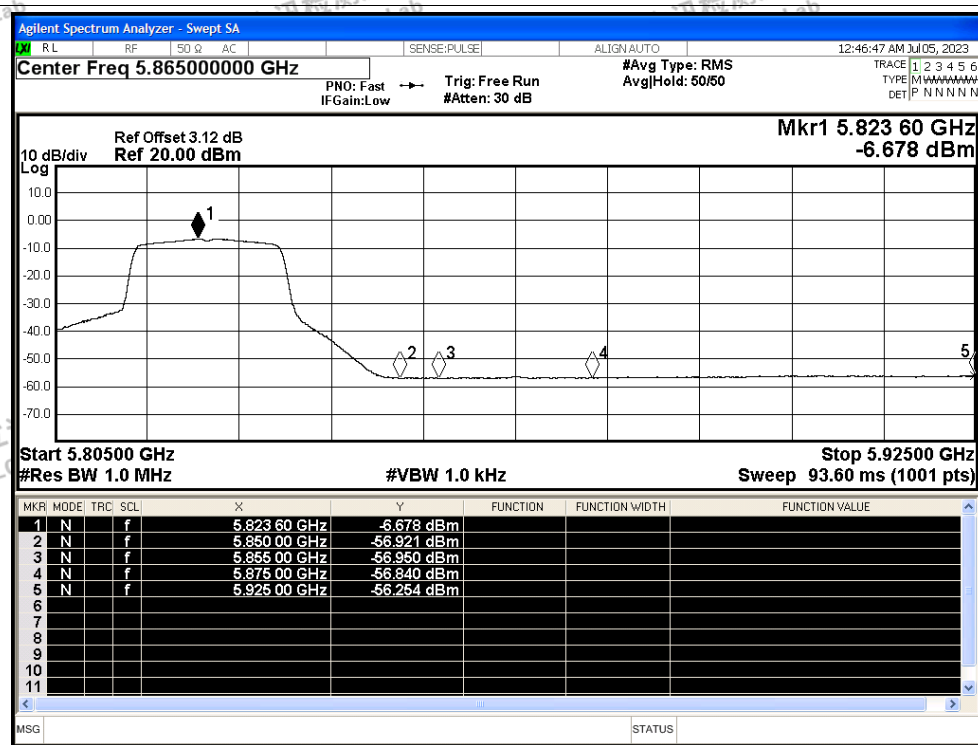




Restrict Band NVNT ax40 5755MHz Ant2 Peak

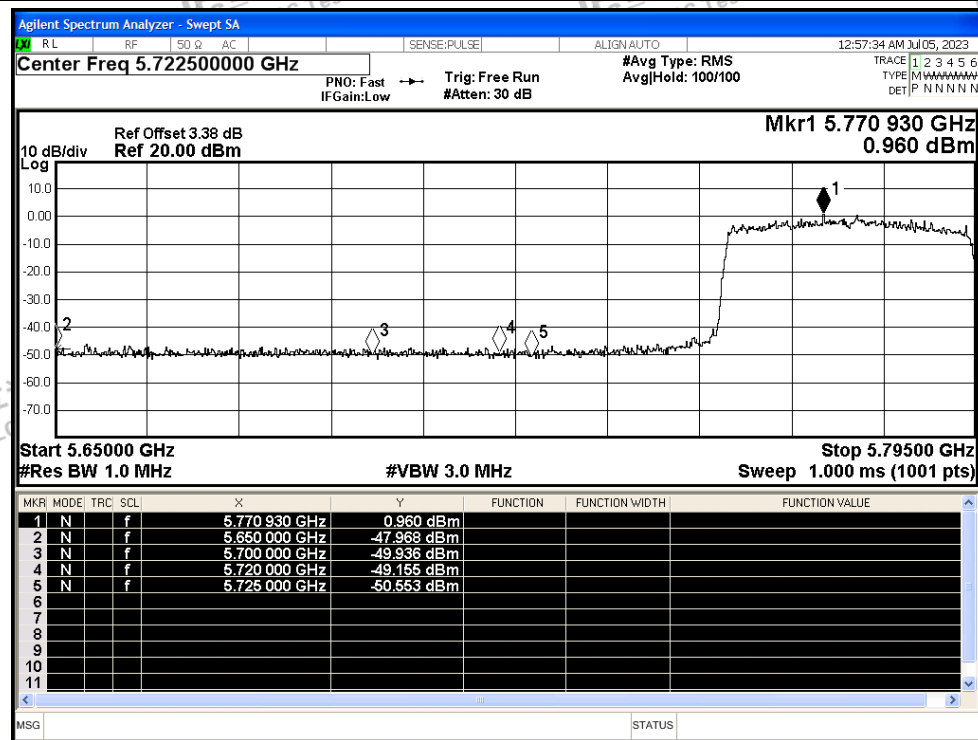


Restrict Band NVNT ax40 5755MHz Ant2 Average

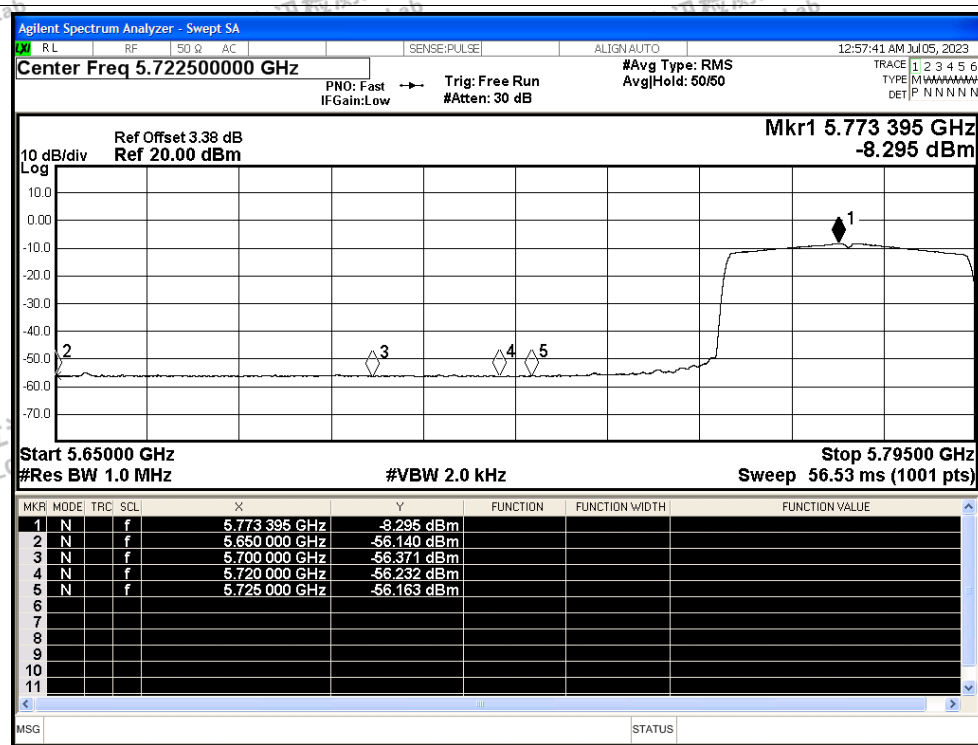




Restrict Band NVNT ax40 5795MHz Ant2 Peak

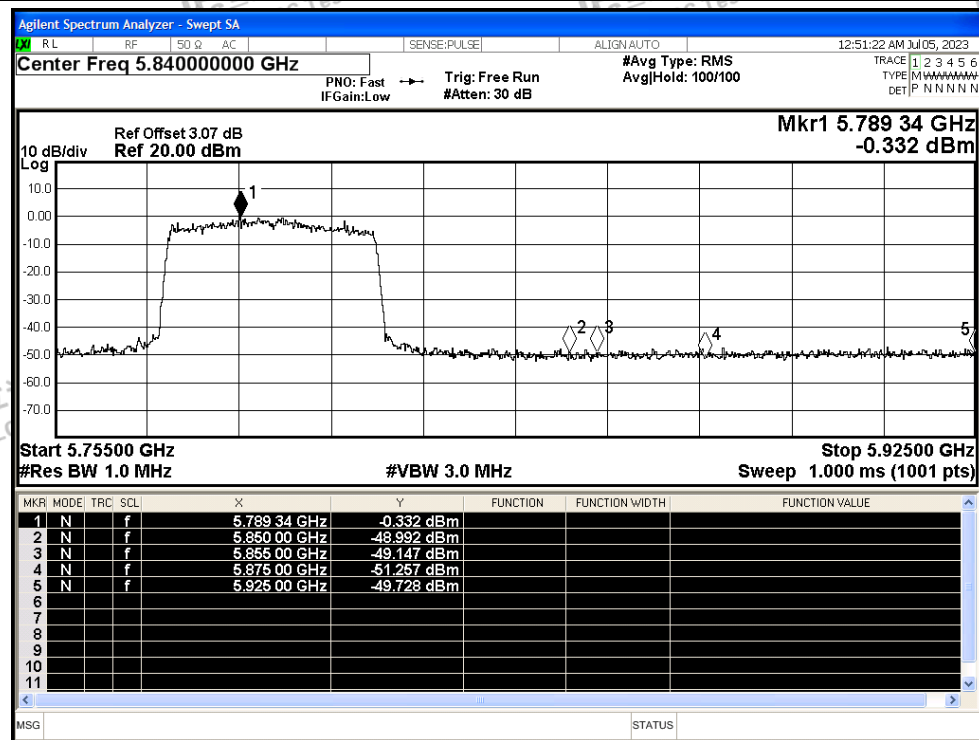


Restrict Band NVNT ax40 5795MHz Ant2 Average

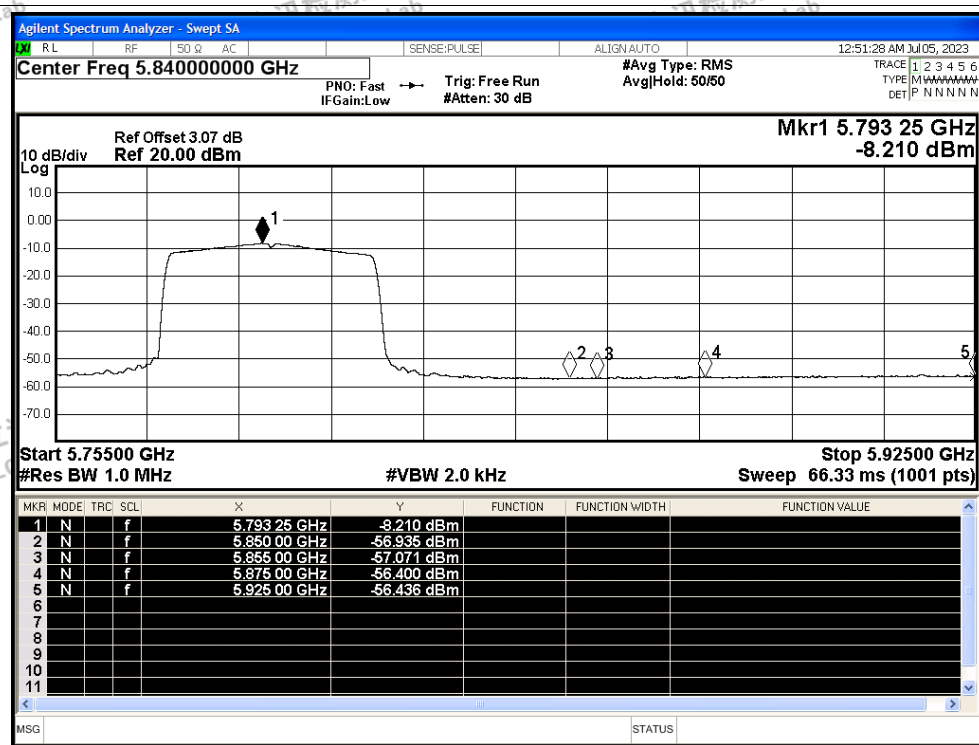




Restrict Band NVNT ax80 5775MHz Ant2 Peak

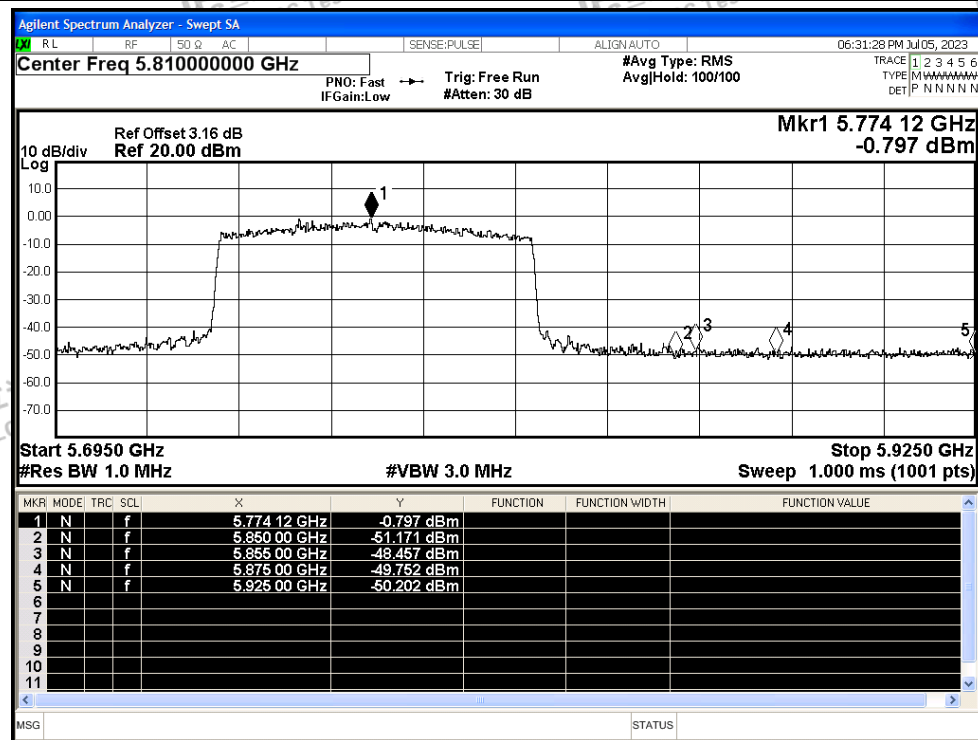


Restrict Band NVNT ax80 5775MHz Ant2 Average

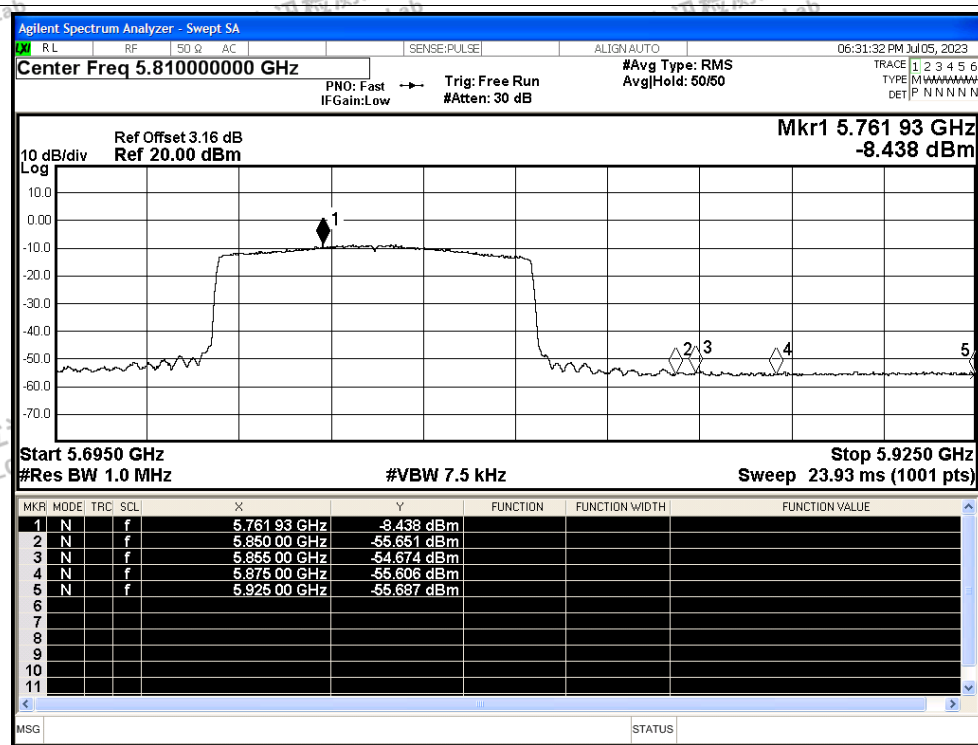




Restrict Band NVNT ax80 5775MHz Ant2 Peak

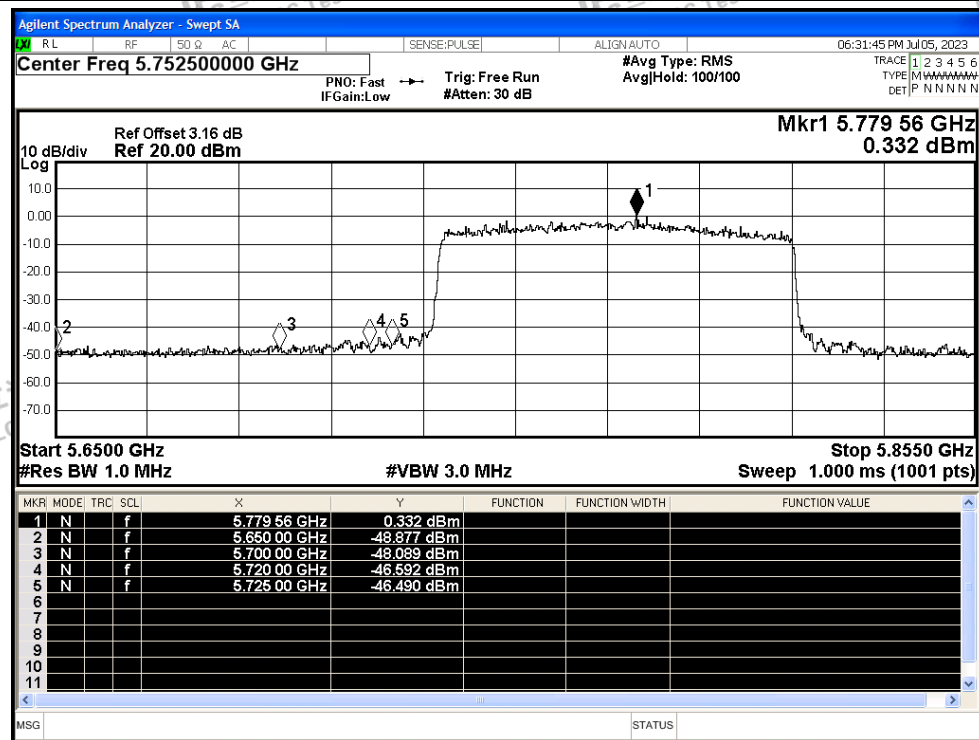

Restrict Band NVNT ax80 5775MHz Ant2 Average

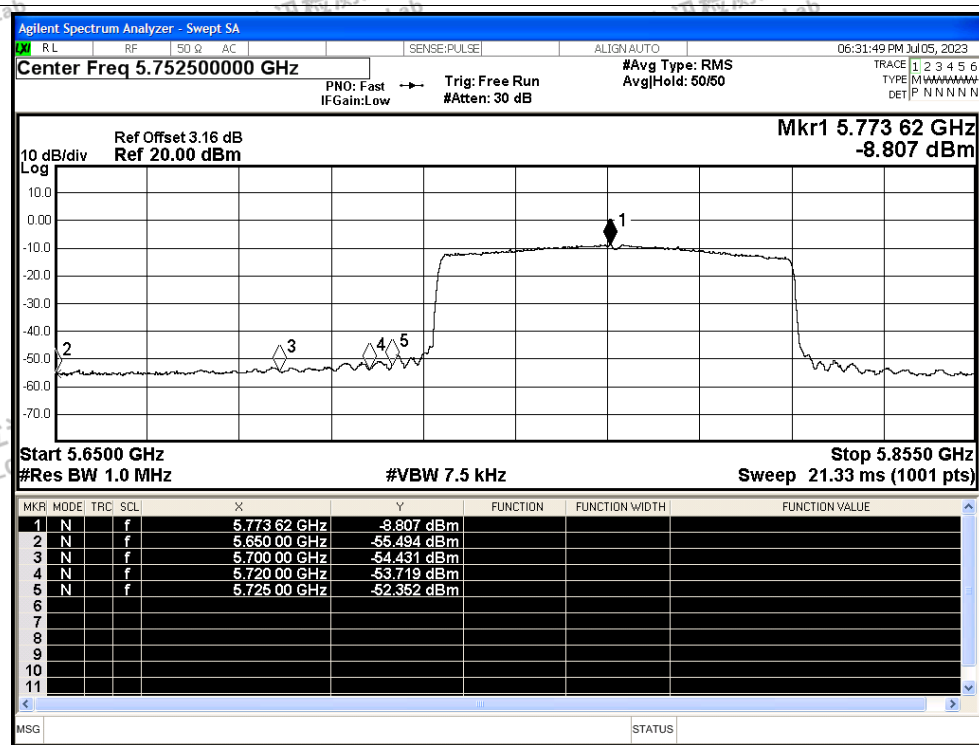



MIMO:

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Antenna		Power (dBm)	Gain (dBi)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
				Ant0	Ant1						
NVNT	n20	5745	5650	-47.41	-50.25	-45.59	9.44	-36.15	Peak	-27	Pass
NVNT	n20	5745	5650	-56.32	-56.68	-53.49	9.44	-44.05	Average	-27	Pass
NVNT	n20	5745	5700	-49.23	-50.43	-46.78	9.44	-37.34	Peak	10	Pass
NVNT	n20	5745	5700	-56.36	-56.41	-53.37	9.44	-43.93	Average	10	Pass
NVNT	n20	5745	5720	-49.14	-48.6	-45.85	9.44	-36.41	Peak	15.6	Pass
NVNT	n20	5745	5720	-55.82	-56.17	-52.98	9.44	-43.54	Average	15.6	Pass
NVNT	n20	5745	5725	-47.74	-48.26	-44.98	9.44	-35.54	Peak	27	Pass
NVNT	n20	5745	5725	-54.89	-55.33	-52.09	9.44	-42.65	Average	27	Pass
NVNT	n20	5825	5850	-50.76	-51.27	-48.00	9.44	-38.56	Peak	27	Pass
NVNT	n20	5825	5850	-57.19	-57.18	-54.17	9.44	-44.73	Average	27	Pass
NVNT	n20	5825	5855	-49.41	-50.15	-46.75	9.44	-37.31	Peak	15.6	Pass
NVNT	n20	5825	5855	-57.26	-57.12	-54.18	9.44	-44.74	Average	15.6	Pass
NVNT	n20	5825	5875	-50.35	-51.03	-47.67	9.44	-38.23	Peak	10	Pass
NVNT	n20	5825	5875	-56.9	-57.06	-53.97	9.44	-44.53	Average	10	Pass
NVNT	n20	5825	5925	-48.36	-50.14	-46.15	9.44	-36.71	Peak	-27	Pass
NVNT	n20	5825	5925	-56.63	-56.64	-53.62	9.44	-44.18	Average	-27	Pass
NVNT	n40	5755	5650	-50.17	-48.39	-46.18	9.44	-36.74	Peak	-27	Pass
NVNT	n40	5755	5650	-55.7	-55.9	-52.79	9.44	-43.35	Average	-27	Pass
NVNT	n40	5755	5700	-49.22	-50.18	-46.66	9.44	-37.22	Peak	10	Pass
NVNT	n40	5755	5700	-55.24	-55.82	-52.51	9.44	-43.07	Average	10	Pass
NVNT	n40	5755	5720	-48.85	-49.05	-45.94	9.44	-36.50	Peak	15.6	Pass
NVNT	n40	5755	5720	-54.73	-55.31	-52.00	9.44	-42.56	Average	15.6	Pass
NVNT	n40	5755	5725	-45.16	-47.07	-43.00	9.44	-33.56	Peak	27	Pass
NVNT	n40	5755	5725	-52.06	-52.13	-49.08	9.44	-39.64	Average	27	Pass
NVNT	n40	5795	5850	-51.04	-50.95	-47.98	9.44	-38.54	Peak	27	Pass
NVNT	n40	5795	5850	-56.58	-56.98	-53.77	9.44	-44.33	Average	27	Pass
NVNT	n40	5795	5855	-51.56	-51.96	-48.75	9.44	-39.31	Peak	15.6	Pass
NVNT	n40	5795	5855	-56.61	-56.72	-53.65	9.44	-44.21	Average	15.6	Pass
NVNT	n40	5795	5875	-50.53	-50.21	-47.36	9.44	-37.92	Peak	10	Pass
NVNT	n40	5795	5875	-56.37	-56.44	-53.39	9.44	-43.95	Average	10	Pass
NVNT	n40	5795	5925	-50.33	-50.69	-47.50	9.44	-38.06	Peak	-27	Pass
NVNT	n40	5795	5925	-56.25	-56.05	-53.14	9.44	-43.70	Average	-27	Pass
NVNT	ac20	5745	5650	-48.18	-50.66	-46.24	9.44	-36.80	Peak	-27	Pass
NVNT	ac20	5745	5650	-56.14	-56.27	-53.19	9.44	-43.75	Average	-27	Pass
NVNT	ac20	5745	5700	-49.74	-50	-46.86	9.44	-37.42	Peak	10	Pass
NVNT	ac20	5745	5700	-56.2	-56.15	-53.16	9.44	-43.72	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5745	5720	-48.77	-49.99	-46.33	9.44	-36.89	Peak	15.6	Pass
NVNT	ac20	5745	5720	-55.72	-55.91	-52.80	9.44	-43.36	Average	15.6	Pass
NVNT	ac20	5745	5725	-48.2	-47.84	-45.01	9.44	-35.57	Peak	27	Pass
NVNT	ac20	5745	5725	-54.34	-55.36	-51.81	9.44	-42.37	Average	27	Pass
NVNT	ac20	5825	5850	-50.31	-48.43	-46.26	9.44	-36.82	Peak	27	Pass
NVNT	ac20	5825	5850	-57.02	-56.68	-53.84	9.44	-44.40	Average	27	Pass
NVNT	ac20	5825	5855	-49.32	-48.99	-46.14	9.44	-36.70	Peak	15.6	Pass
NVNT	ac20	5825	5855	-56.97	-56.81	-53.88	9.44	-44.44	Average	15.6	Pass
NVNT	ac20	5825	5875	-49.53	-49.51	-46.51	9.44	-37.07	Peak	10	Pass
NVNT	ac20	5825	5875	-56.62	-56.7	-53.65	9.44	-44.21	Average	10	Pass
NVNT	ac20	5825	5925	-47.41	-49.2	-45.20	9.44	-35.76	Peak	-27	Pass
NVNT	ac20	5825	5925	-56.12	-56.41	-53.25	9.44	-43.81	Average	-27	Pass
NVNT	ac40	5755	5650	-49.83	-49.06	-46.42	9.44	-36.98	Peak	-27	Pass
NVNT	ac40	5755	5650	-55.64	-55.69	-52.65	9.44	-43.21	Average	-27	Pass
NVNT	ac40	5755	5700	-50.17	-49.6	-46.87	9.44	-37.43	Peak	10	Pass
NVNT	ac40	5755	5700	-55.48	-55.93	-52.69	9.44	-43.25	Average	10	Pass
NVNT	ac40	5755	5720	-49.64	-49.51	-46.56	9.44	-37.12	Peak	15.6	Pass
NVNT	ac40	5755	5720	-54.78	-55.26	-52.00	9.44	-42.56	Average	15.6	Pass
NVNT	ac40	5755	5725	-46.22	-46.92	-43.55	9.44	-34.11	Peak	27	Pass
NVNT	ac40	5755	5725	-52.21	-52.15	-49.17	9.44	-39.73	Average	27	Pass
NVNT	ac40	5795	5850	-49.9	-50.61	-47.23	9.44	-37.79	Peak	27	Pass
NVNT	ac40	5795	5850	-56.6	-56.88	-53.73	9.44	-44.29	Average	27	Pass
NVNT	ac40	5795	5855	-50.16	-50.14	-47.14	9.44	-37.70	Peak	15.6	Pass
NVNT	ac40	5795	5855	-56.66	-56.35	-53.49	9.44	-44.05	Average	15.6	Pass
NVNT	ac40	5795	5875	-51.13	-49.63	-47.31	9.44	-37.87	Peak	10	Pass
NVNT	ac40	5795	5875	-56.26	-56.1	-53.17	9.44	-43.73	Average	10	Pass
NVNT	ac40	5795	5925	-49.87	-50.98	-47.38	9.44	-37.94	Peak	-27	Pass
NVNT	ac40	5795	5925	-56.24	-56.18	-53.20	9.44	-43.76	Average	-27	Pass
NVNT	ac80	5775	5850	-49.74	-50.85	-47.25	9.44	-37.81	Peak	27	Pass
NVNT	ac80	5775	5850	-55.6	-55.78	-52.68	9.44	-43.24	Average	27	Pass
NVNT	ac80	5775	5855	-50.3	-49.61	-46.93	9.44	-37.49	Peak	15.6	Pass
NVNT	ac80	5775	5855	-55.91	-55.75	-52.82	9.44	-43.38	Average	15.6	Pass
NVNT	ac80	5775	5875	-49.88	-48.45	-46.10	9.44	-36.66	Peak	10	Pass
NVNT	ac80	5775	5875	-55.71	-55.26	-52.47	9.44	-43.03	Average	10	Pass
NVNT	ac80	5775	5925	-49.84	-49.51	-46.66	9.44	-37.22	Peak	-27	Pass
NVNT	ac80	5775	5925	-55.63	-55.21	-52.40	9.44	-42.96	Average	-27	Pass
NVNT	ac80	5775	5650	-50.94	-50.82	-47.87	9.44	-38.43	Peak	-27	Pass
NVNT	ac80	5775	5650	-55.53	-55.7	-52.60	9.44	-43.16	Average	-27	Pass
NVNT	ac80	5775	5700	-48.17	-49.01	-45.56	9.44	-36.12	Peak	10	Pass
NVNT	ac80	5775	5700	-54.71	-55.34	-52.00	9.44	-42.56	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	5720	-48.71	-51.16	-46.75	9.44	-37.31	Peak	15.6	Pass
NVNT	ac80	5775	5720	-54.43	-55.42	-51.89	9.44	-42.45	Average	15.6	Pass
NVNT	ac80	5775	5725	-47.88	-49.35	-45.54	9.44	-36.10	Peak	27	Pass
NVNT	ac80	5775	5725	-52.45	-53.42	-49.90	9.44	-40.46	Average	27	Pass
NVNT	ax20	5745	5650	-48.87	-49.37	-46.10	9.44	-36.66	Peak	-27	Pass
NVNT	ax20	5745	5650	-55.88	-55.93	-52.89	9.44	-43.45	Average	-27	Pass
NVNT	ax20	5745	5700	-47.81	-47.55	-44.67	9.44	-35.23	Peak	10	Pass
NVNT	ax20	5745	5700	-55.76	-55.95	-52.84	9.44	-43.40	Average	10	Pass
NVNT	ax20	5745	5720	-48.38	-49.79	-46.02	9.44	-36.58	Peak	15.6	Pass
NVNT	ax20	5745	5720	-55.7	-55.81	-52.74	9.44	-43.30	Average	15.6	Pass
NVNT	ax20	5745	5725	-49.03	-48.3	-45.64	9.44	-36.20	Peak	27	Pass
NVNT	ax20	5745	5725	-54.24	-54.92	-51.56	9.44	-42.12	Average	27	Pass
NVNT	ax20	5825	5850	-50.99	-49.26	-47.03	9.44	-37.59	Peak	27	Pass
NVNT	ax20	5825	5850	-56.79	-56.51	-53.64	9.44	-44.20	Average	27	Pass
NVNT	ax20	5825	5855	-51.39	-50.34	-47.82	9.44	-38.38	Peak	15.6	Pass
NVNT	ax20	5825	5855	-56.87	-56.3	-53.57	9.44	-44.13	Average	15.6	Pass
NVNT	ax20	5825	5875	-51.19	-50.17	-47.64	9.44	-38.20	Peak	10	Pass
NVNT	ax20	5825	5875	-56.52	-56.49	-53.49	9.44	-44.05	Average	10	Pass
NVNT	ax20	5825	5925	-50.06	-50.11	-47.07	9.44	-37.63	Peak	-27	Pass
NVNT	ax20	5825	5925	-56.4	-56.27	-53.32	9.44	-43.88	Average	-27	Pass
NVNT	ax40	5755	5650	-50.56	-49.8	-47.15	9.44	-37.71	Peak	-27	Pass
NVNT	ax40	5755	5650	-55.89	-55.72	-52.79	9.44	-43.35	Average	-27	Pass
NVNT	ax40	5755	5700	-47.48	-48.61	-45.00	9.44	-35.56	Peak	10	Pass
NVNT	ax40	5755	5700	-55.3	-55.7	-52.49	9.44	-43.05	Average	10	Pass
NVNT	ax40	5755	5720	-48.06	-46.41	-44.15	9.44	-34.71	Peak	15.6	Pass
NVNT	ax40	5755	5720	-54.68	-51.92	-50.07	9.44	-40.63	Average	15.6	Pass
NVNT	ax40	5755	5725	-46.72	-24.94	-24.91	9.44	-15.47	Peak	27	Pass
NVNT	ax40	5755	5725	-52.05	-24.25	-24.24	9.44	-14.80	Average	27	Pass
NVNT	ax40	5795	5850	-51.32	-50.83	-48.06	9.44	-38.62	Peak	27	Pass
NVNT	ax40	5795	5850	-56.55	-56.37	-53.45	9.44	-44.01	Average	27	Pass
NVNT	ax40	5795	5855	-49.76	-50.96	-47.31	9.44	-37.87	Peak	15.6	Pass
NVNT	ax40	5795	5855	-56.82	-56.28	-53.53	9.44	-44.09	Average	15.6	Pass
NVNT	ax40	5795	5875	-51.17	-48.88	-46.87	9.44	-37.43	Peak	10	Pass
NVNT	ax40	5795	5875	-56.48	-56.02	-53.23	9.44	-43.79	Average	10	Pass
NVNT	ax40	5795	5925	-49.24	-50.28	-46.72	9.44	-37.28	Peak	-27	Pass
NVNT	ax40	5795	5925	-55.97	-55.98	-52.96	9.44	-43.52	Average	-27	Pass
NVNT	ax80	5775	5850	-50.63	-50.32	-47.46	9.44	-38.02	Peak	27	Pass
NVNT	ax80	5775	5850	-55.06	-55.7	-52.36	9.44	-42.92	Average	27	Pass
NVNT	ax80	5775	5855	-49.08	-50.77	-46.83	9.44	-37.39	Peak	15.6	Pass
NVNT	ax80	5775	5855	-55.35	-55.32	-52.32	9.44	-42.88	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5775	5875	-48	-51.08	-46.26	9.44	-36.82	Peak	10	Pass
NVNT	ax80	5775	5875	-55.87	-55.47	-52.66	9.44	-43.22	Average	10	Pass
NVNT	ax80	5775	5925	-51.28	-51.21	-48.23	9.44	-38.79	Peak	-27	Pass
NVNT	ax80	5775	5925	-55.54	-55.54	-52.53	9.44	-43.09	Average	-27	Pass
NVNT	ax80	5775	5650	-50.28	-49.57	-46.90	9.44	-37.46	Peak	-27	Pass
NVNT	ax80	5775	5650	-55.29	-55.62	-52.44	9.44	-43.00	Average	-27	Pass
NVNT	ax80	5775	5700	-46.63	-49.72	-44.90	9.44	-35.46	Peak	10	Pass
NVNT	ax80	5775	5700	-54.54	-55.55	-52.01	9.44	-42.57	Average	10	Pass
NVNT	ax80	5775	5720	-48	-49.59	-45.71	9.44	-36.27	Peak	15.6	Pass
NVNT	ax80	5775	5720	-53.93	-55	-51.42	9.44	-41.98	Average	15.6	Pass
NVNT	ax80	5775	5725	-47.81	-47.91	-44.85	9.44	-35.41	Peak	27	Pass
NVNT	ax80	5775	5725	-52.29	-53.67	-49.92	9.44	-40.48	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



C.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	n40	5755	Ant0	5755	0	0	25	Pass
NVNT	n40	5795	Ant0	5795	0	0	25	Pass
NVNT	ac20	5745	Ant0	5744.96	-40000	-6.96	25	Pass
NVNT	ac20	5785	Ant0	5784.96	-40000	-6.91	25	Pass
NVNT	ac20	5825	Ant0	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant0	5755	0	0	25	Pass
NVNT	ac40	5795	Ant0	5794.92	-80000	-13.81	25	Pass
NVNT	ac80	5775	Ant0	5774.92	-80000	-13.85	25	Pass
NVNT	ax20	5745	Ant0	5744.96	-40000	-6.96	25	Pass
NVNT	ax20	5785	Ant0	5784.96	-40000	-6.91	25	Pass
NVNT	ax20	5825	Ant0	5824.96	-40000	-6.87	25	Pass
NVNT	ax40	5755	Ant0	5754.96	-40000	-6.95	25	Pass
NVNT	ax40	5795	Ant0	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant0	5775	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT n40 5755MHz Ant0

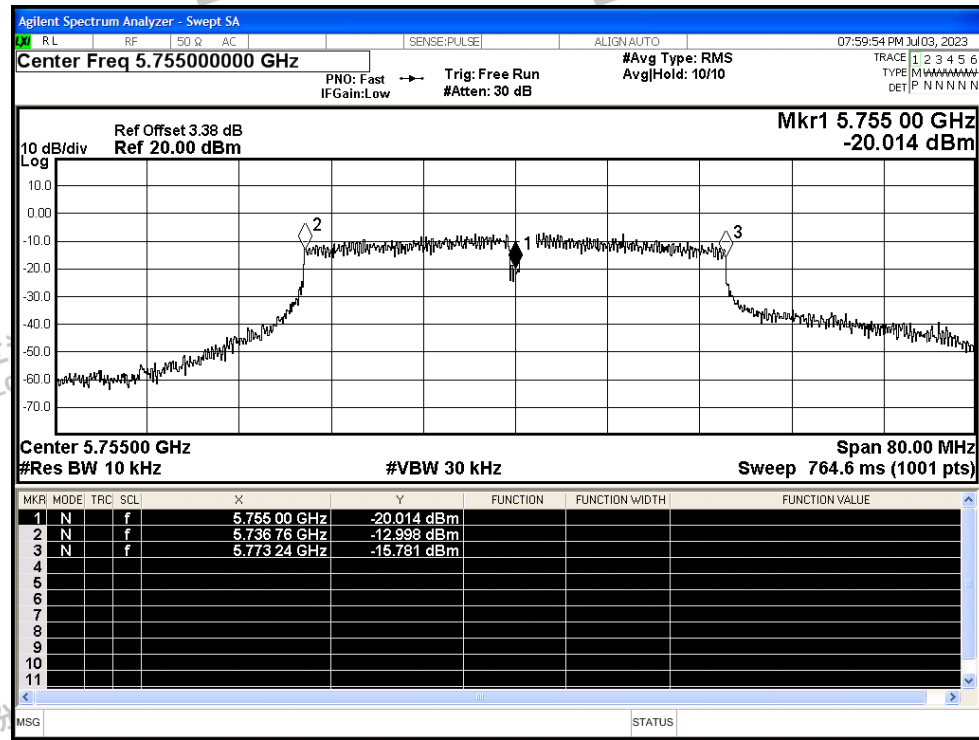

Freq. Stability NVNT n40 5795MHz Ant0

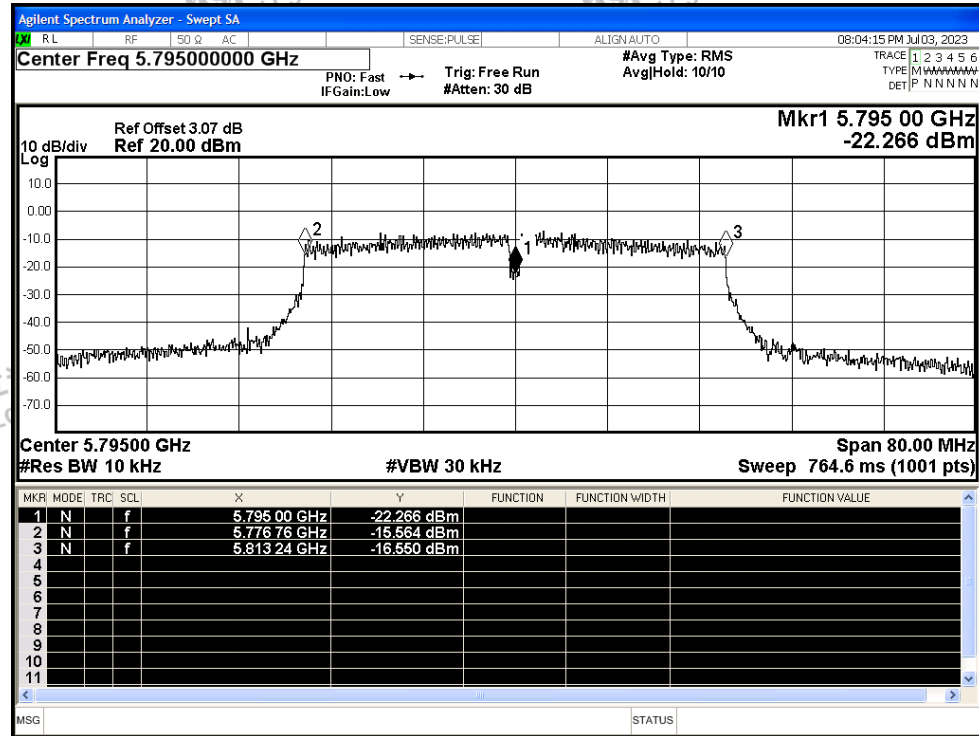

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant0

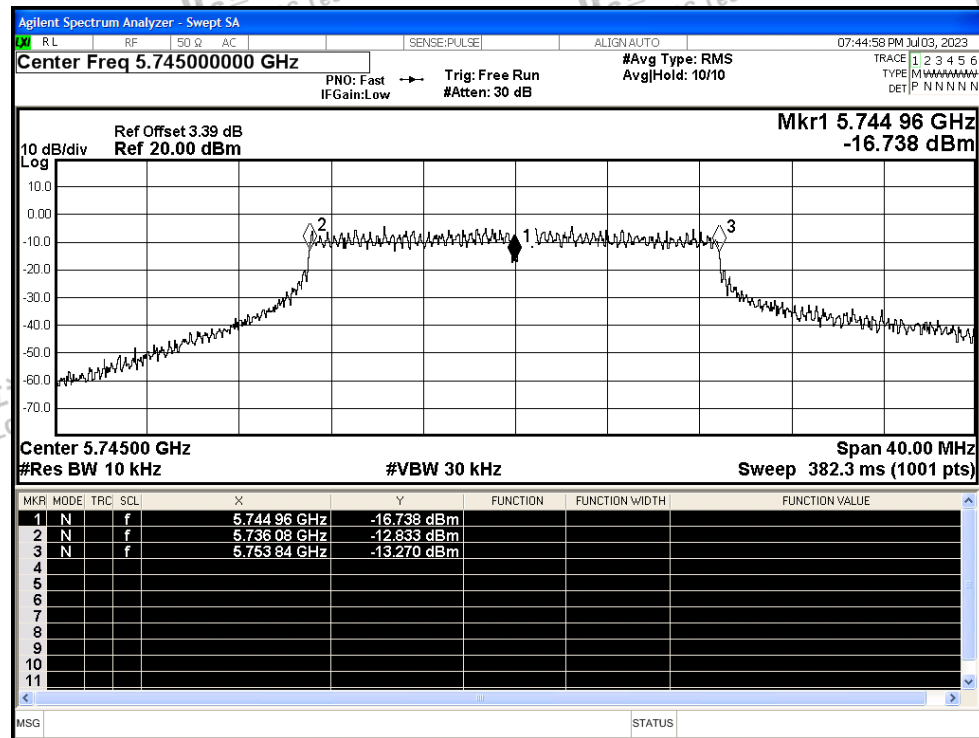


Freq. Stability NVNT ac20 5785MHz Ant0

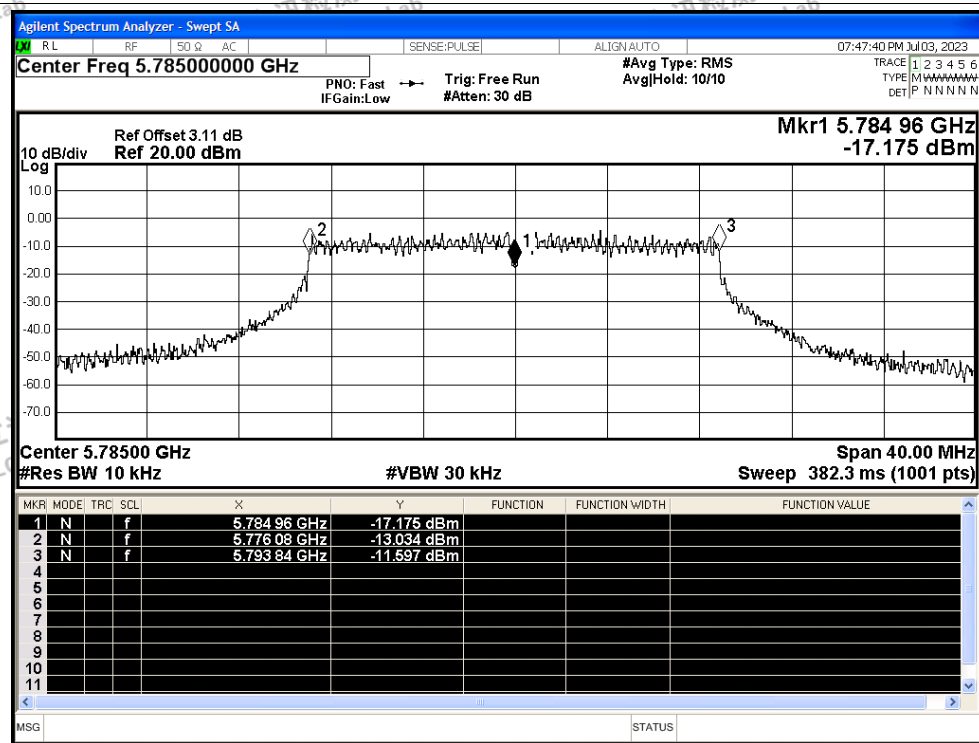




Freq. Stability NVNT ac20 5825MHz Ant0

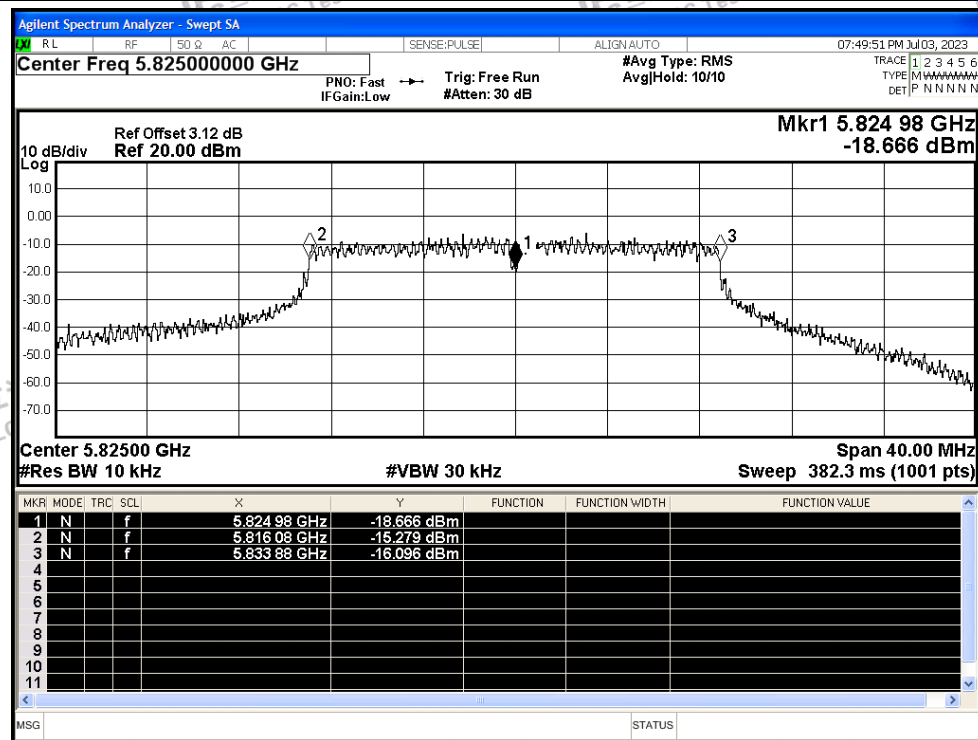


Freq. Stability NVNT ac40 5755MHz Ant0

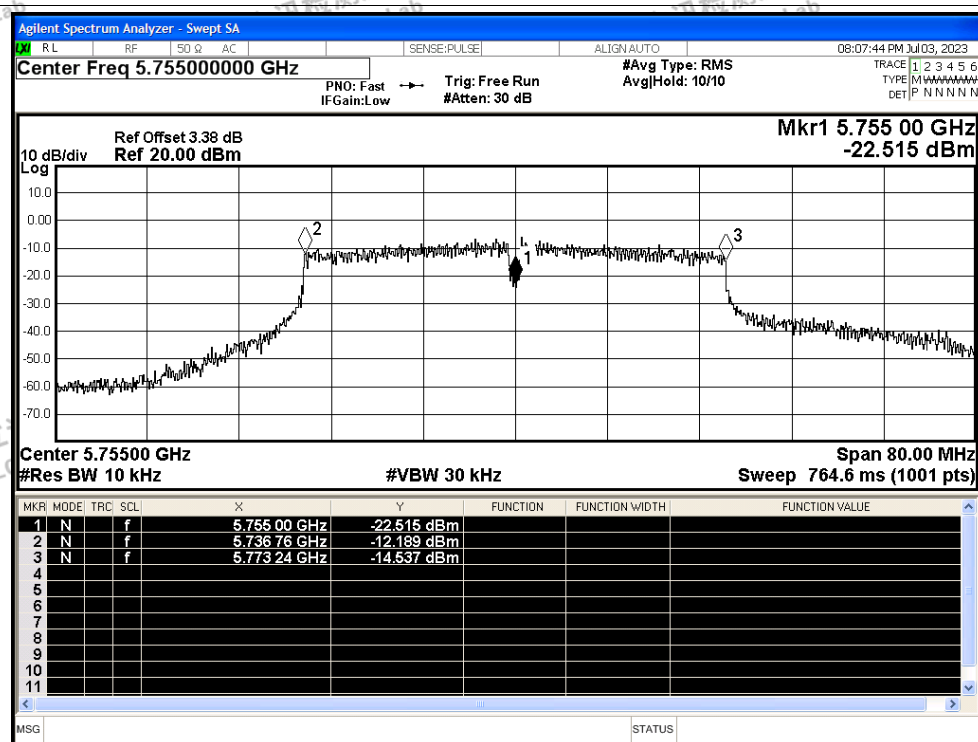




Freq. Stability NVNT ac40 5795MHz Ant0

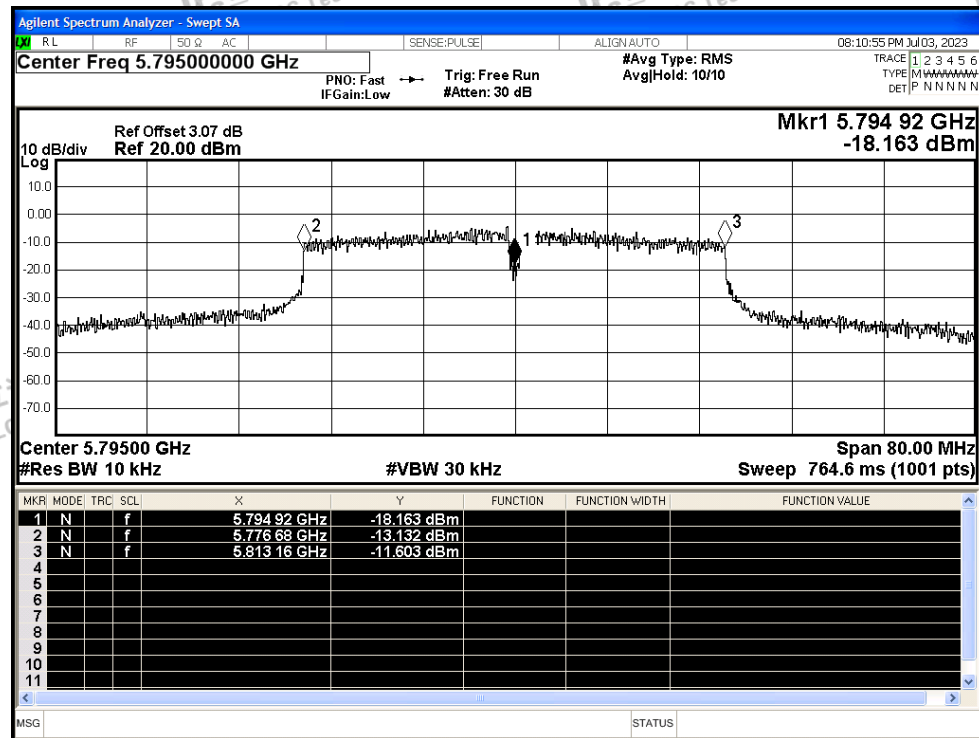

Freq. Stability NVNT ac80 5775MHz Ant0

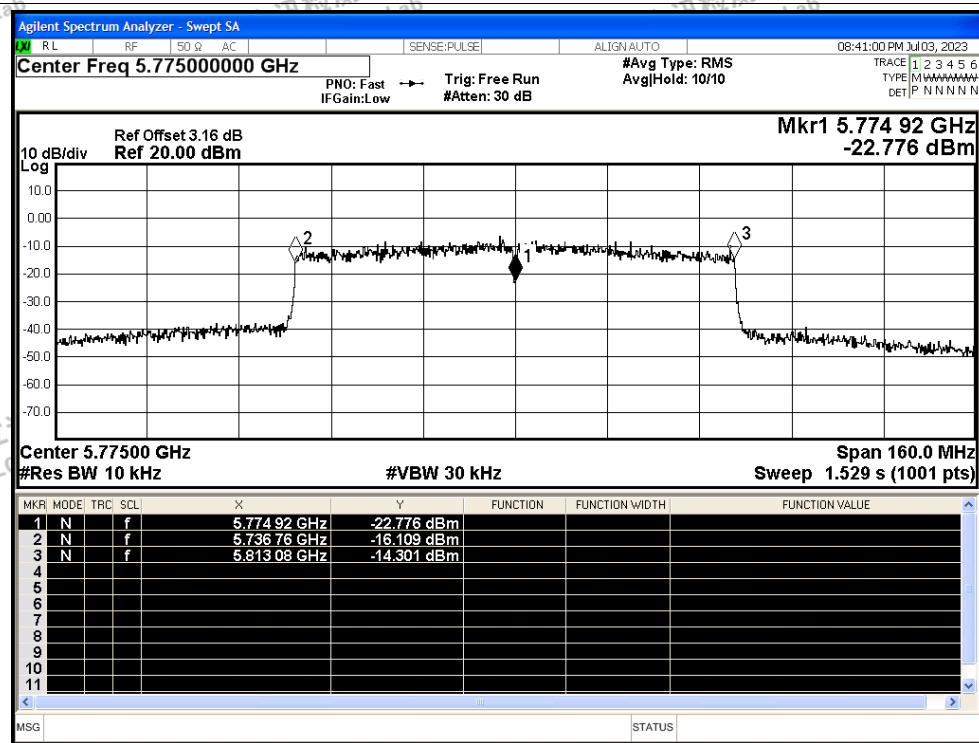

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant0

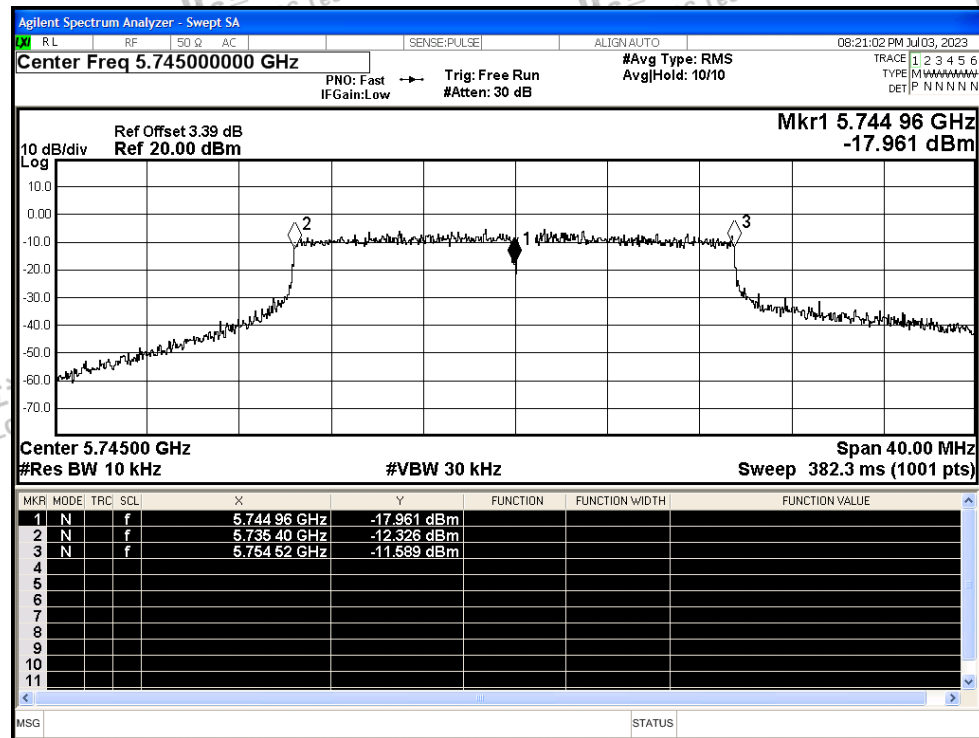


Freq. Stability NVNT ax20 5785MHz Ant0

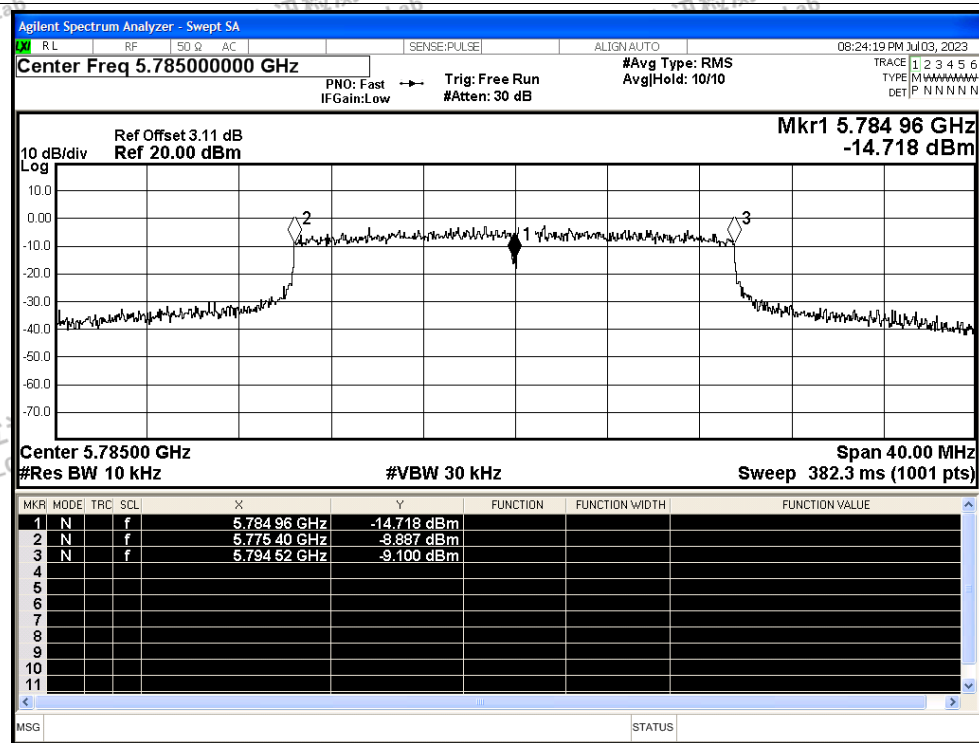




Freq. Stability NVNT ax20 5825MHz Ant0

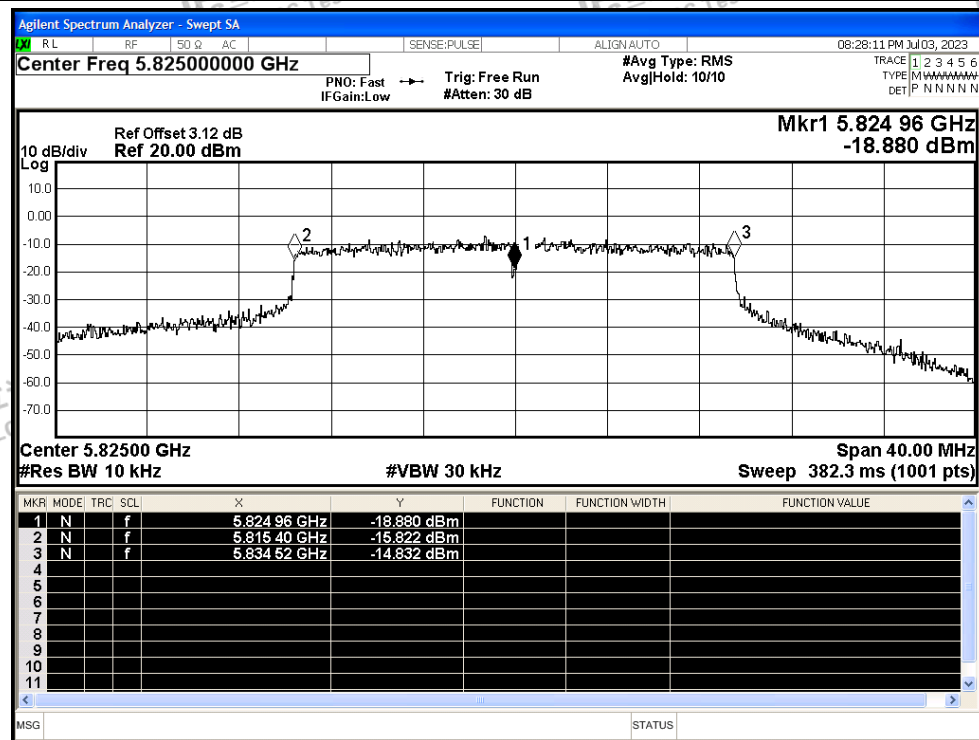


Freq. Stability NVNT ax40 5755MHz Ant0

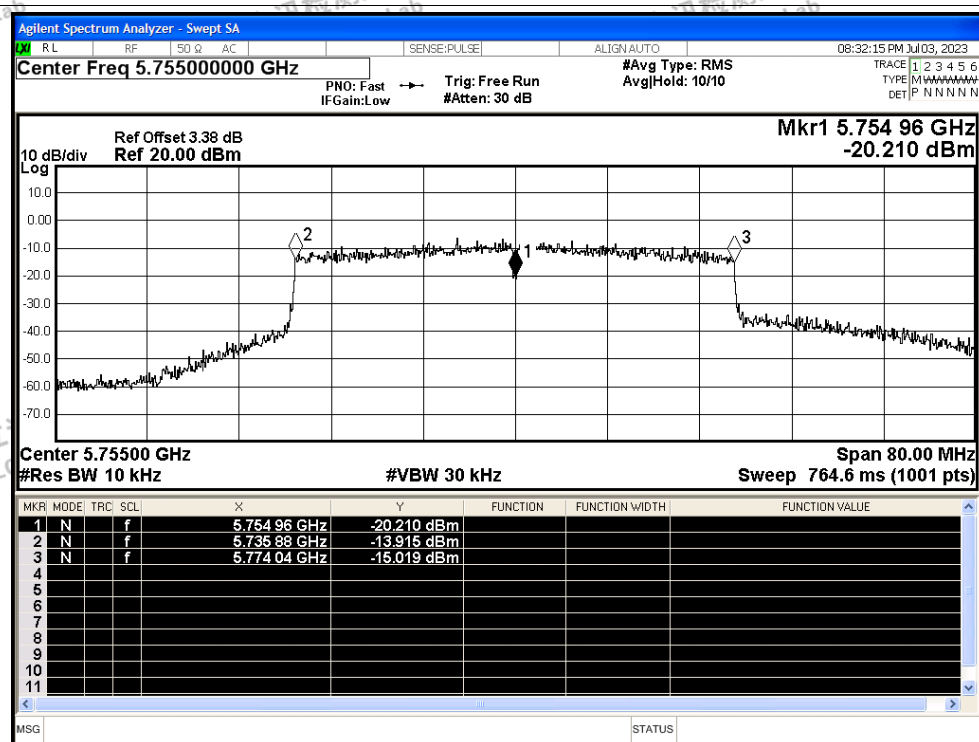




Freq. Stability NVNT ax40 5795MHz Ant0

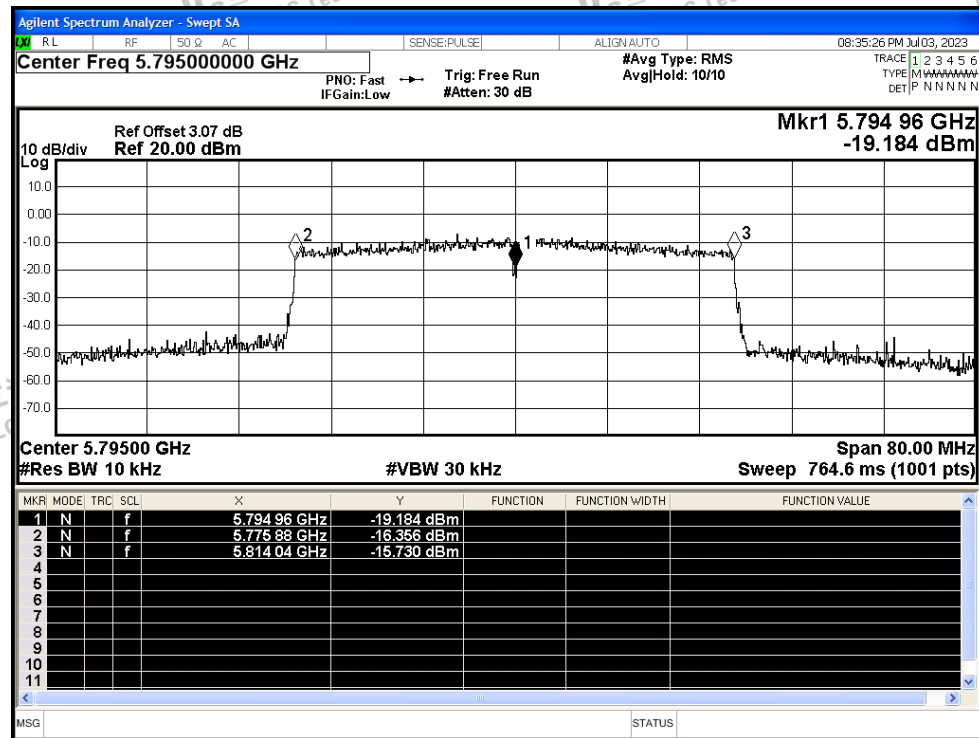

Freq. Stability NVNT ax80 5775MHz Ant0

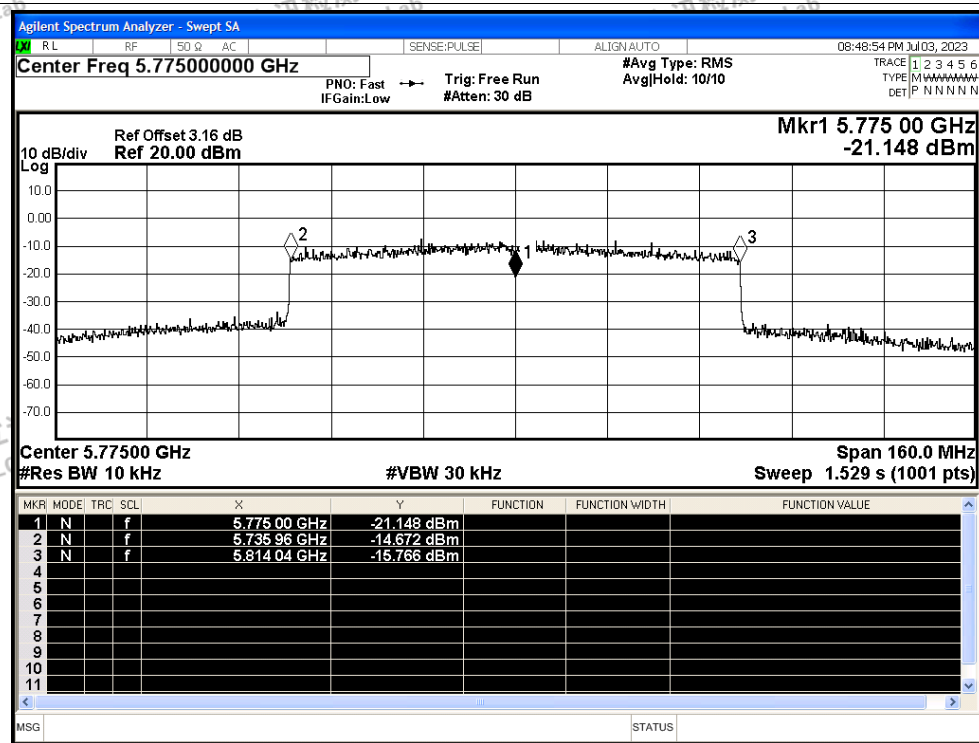

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
NVNT	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
NVNT	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
NVNT	ac20	5785	Ant1	5785	0	0	25	Pass
NVNT	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant1	5795	0	0	25	Pass
NVNT	ac80	5775	Ant1	5775	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT n40 5755MHz Ant1

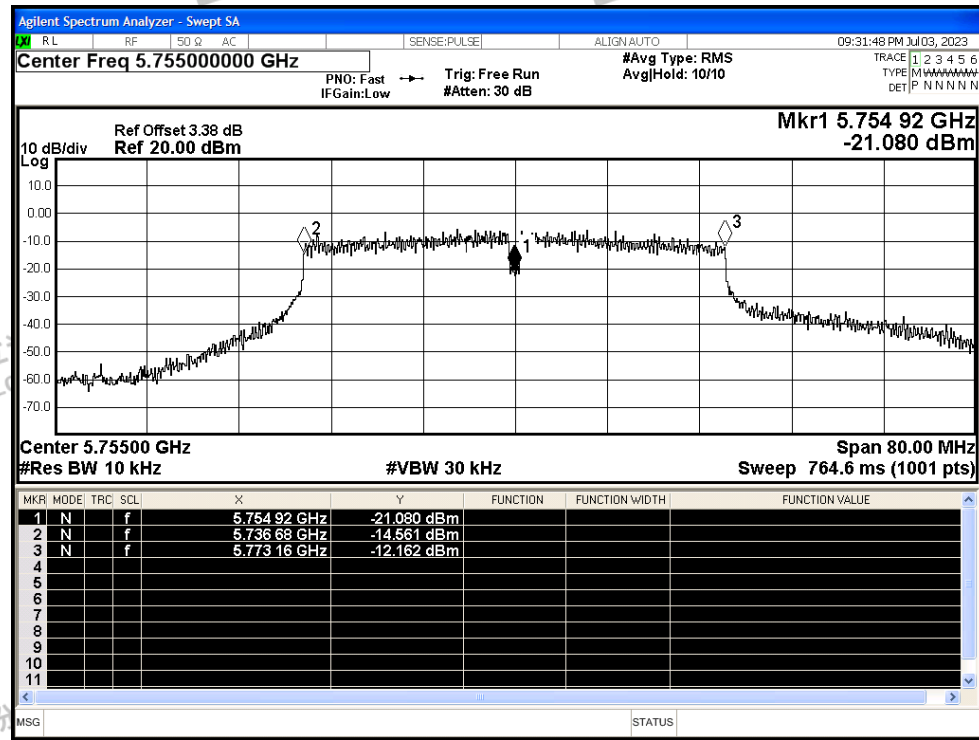

Freq. Stability NVNT n40 5795MHz Ant1

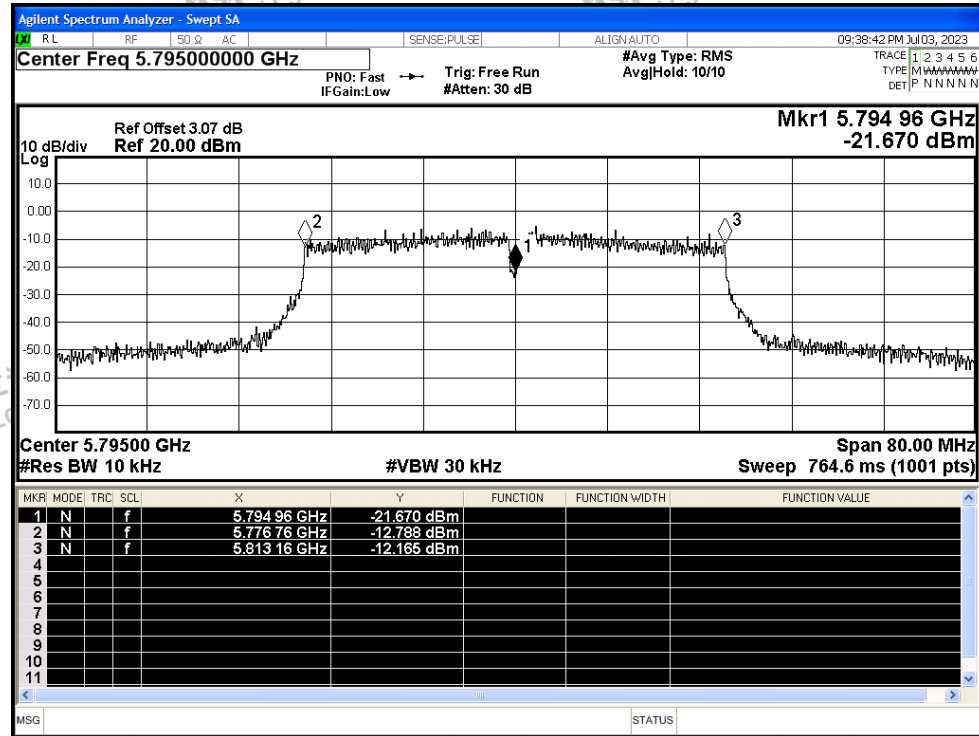

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant1

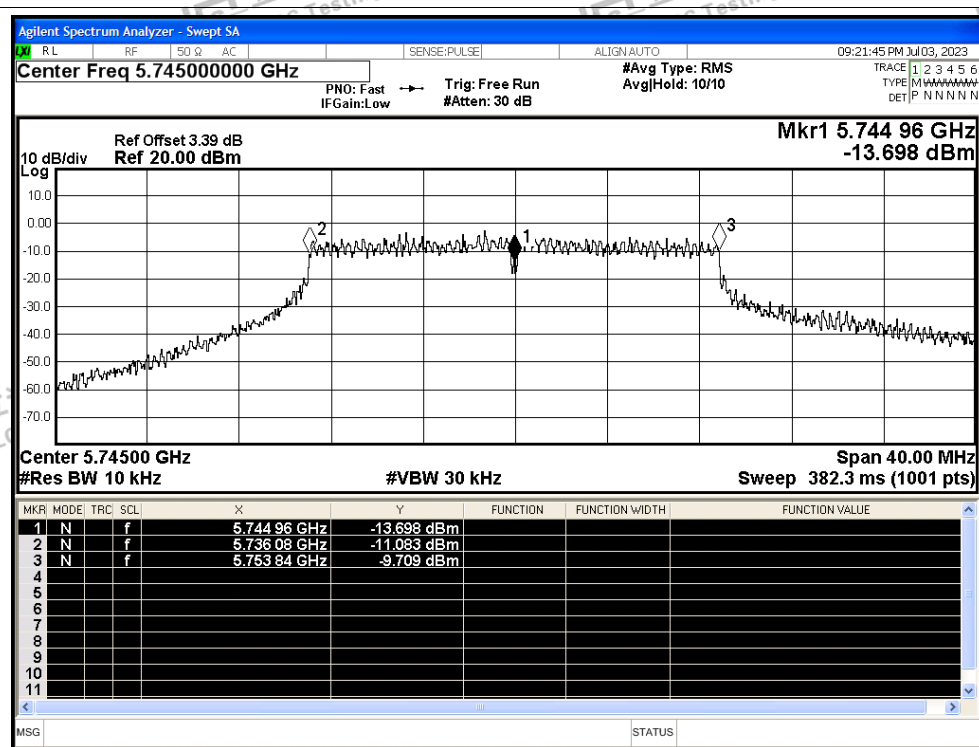


Freq. Stability NVNT ac20 5785MHz Ant1

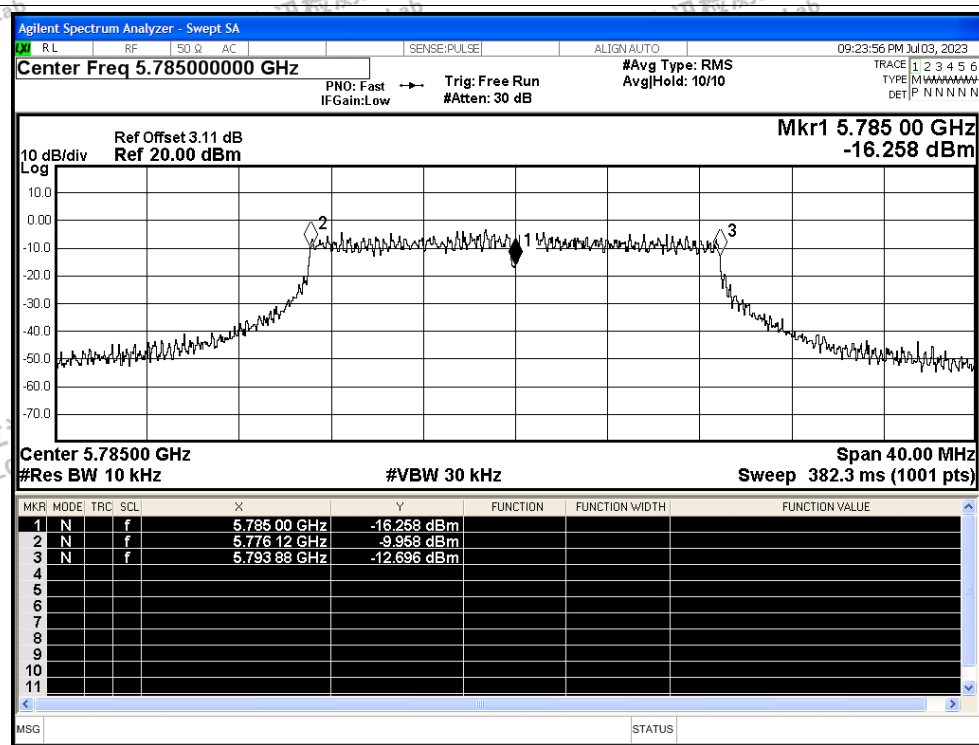




Freq. Stability NVNT ac20 5825MHz Ant1

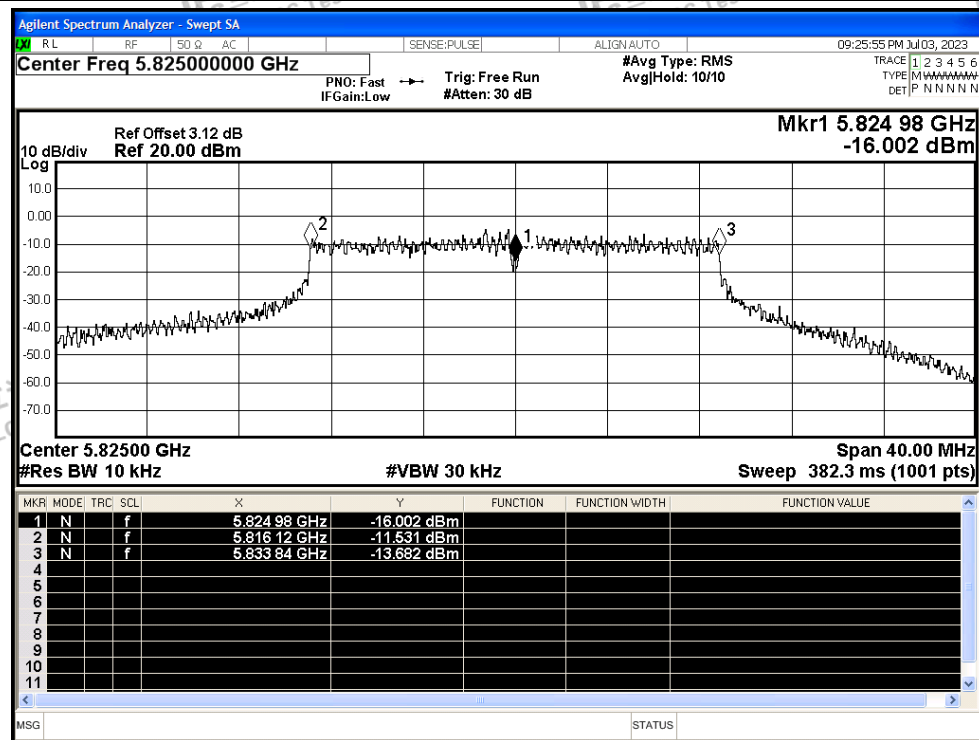


Freq. Stability NVNT ac40 5755MHz Ant1

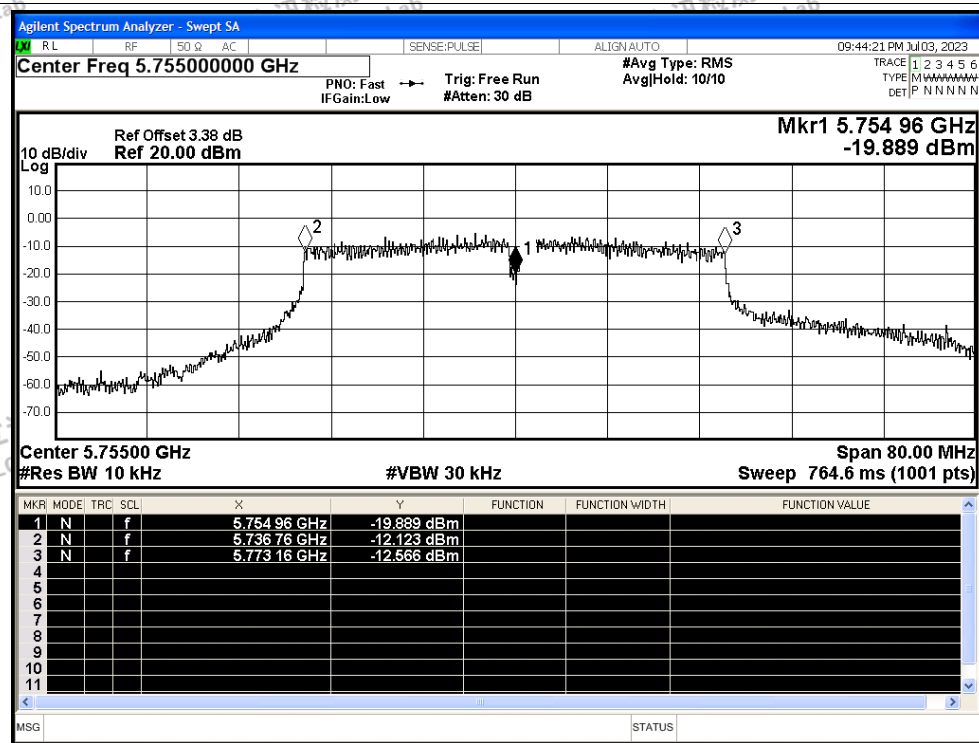


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant1

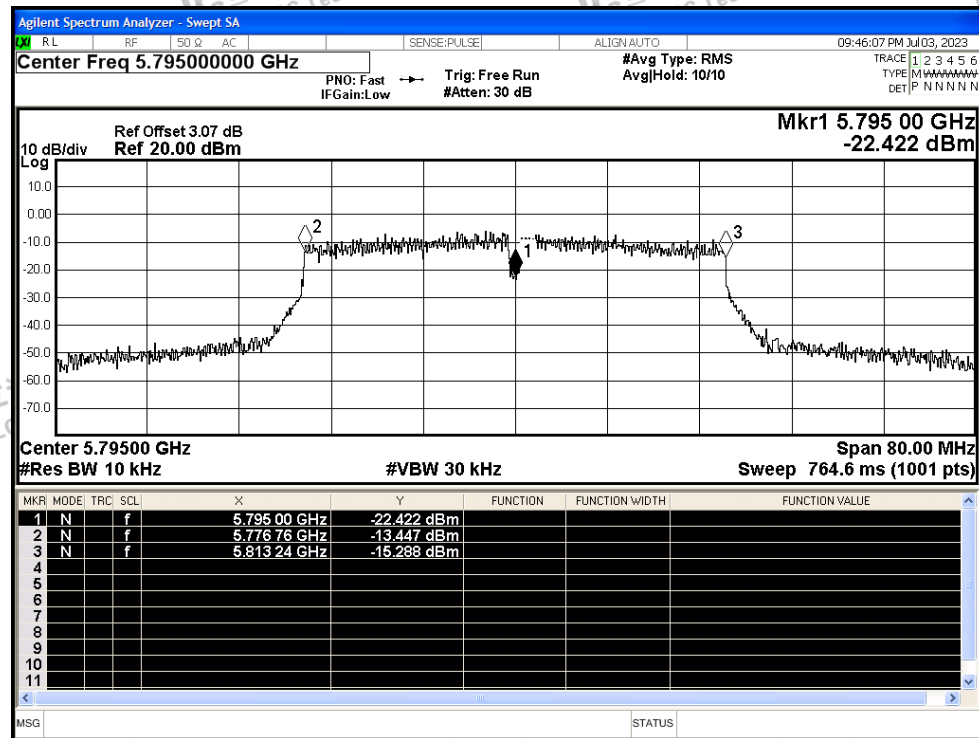

Freq. Stability NVNT ac80 5775MHz Ant1

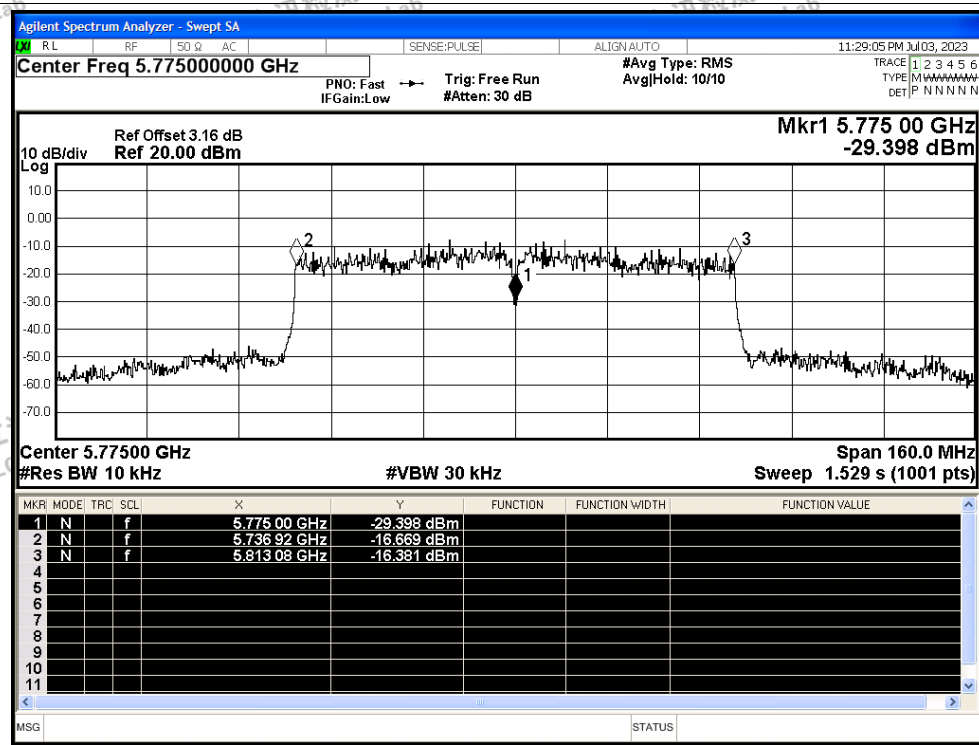

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	n40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
NVNT	ac20	5745	Ant2	5744.96	-40000	-6.96	25	Pass
NVNT	ac20	5785	Ant2	5784.96	-40000	-6.91	25	Pass
NVNT	ac20	5825	Ant2	5824.94	-60000	-10.3	25	Pass
NVNT	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant2	5794.92	-80000	-13.81	25	Pass
NVNT	ac80	5775	Ant2	5775	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT n40 5755MHz Ant2

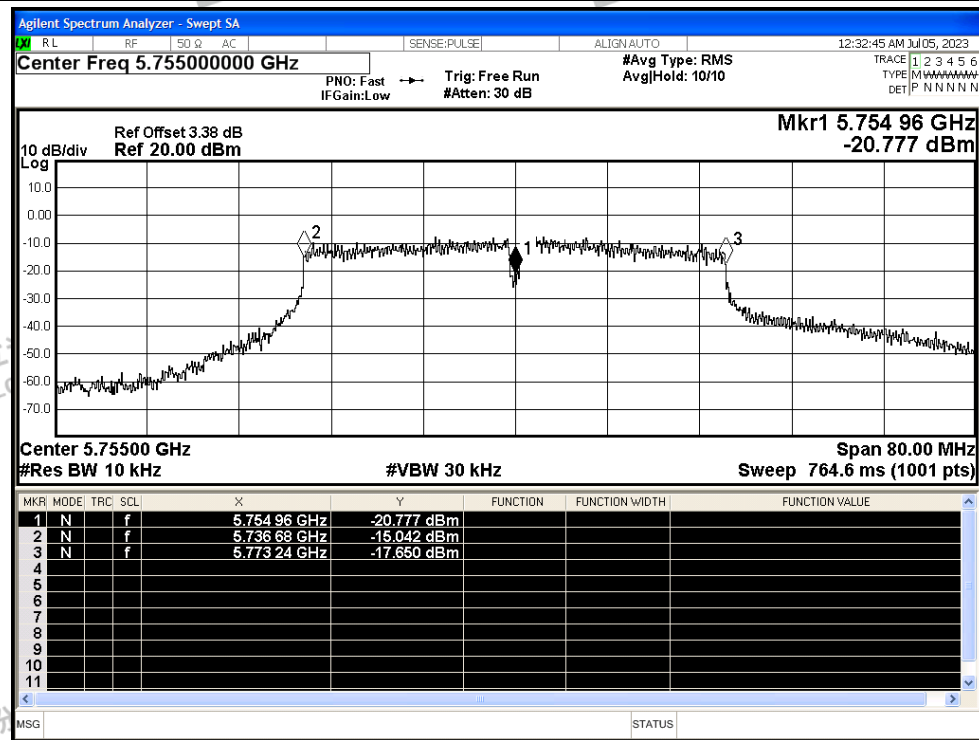

Freq. Stability NVNT n40 5795MHz Ant2

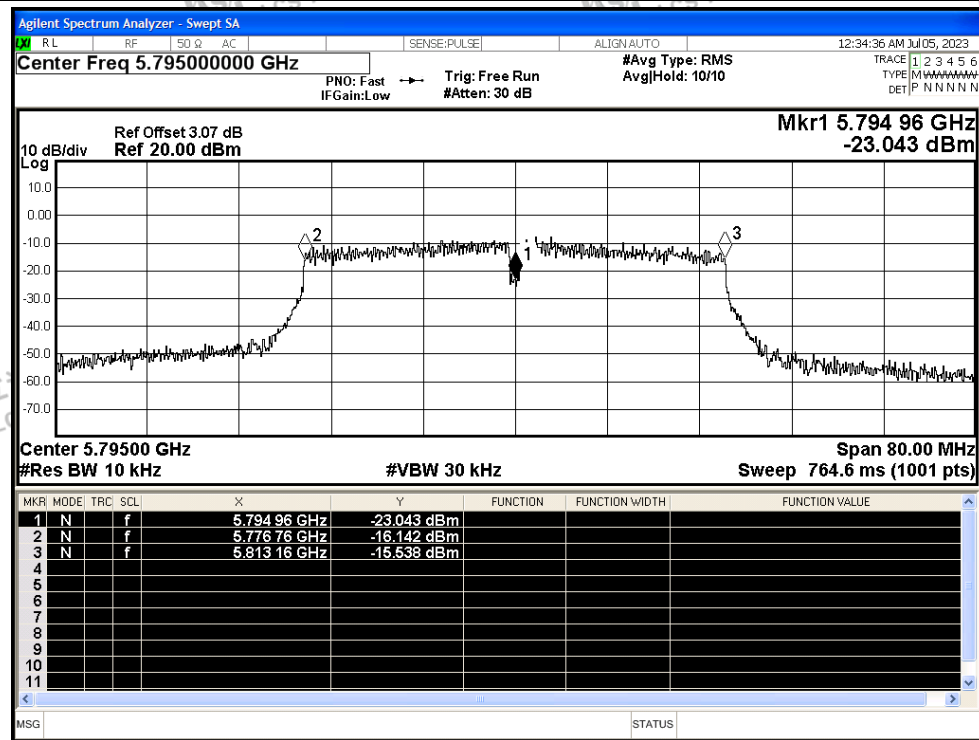

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant2

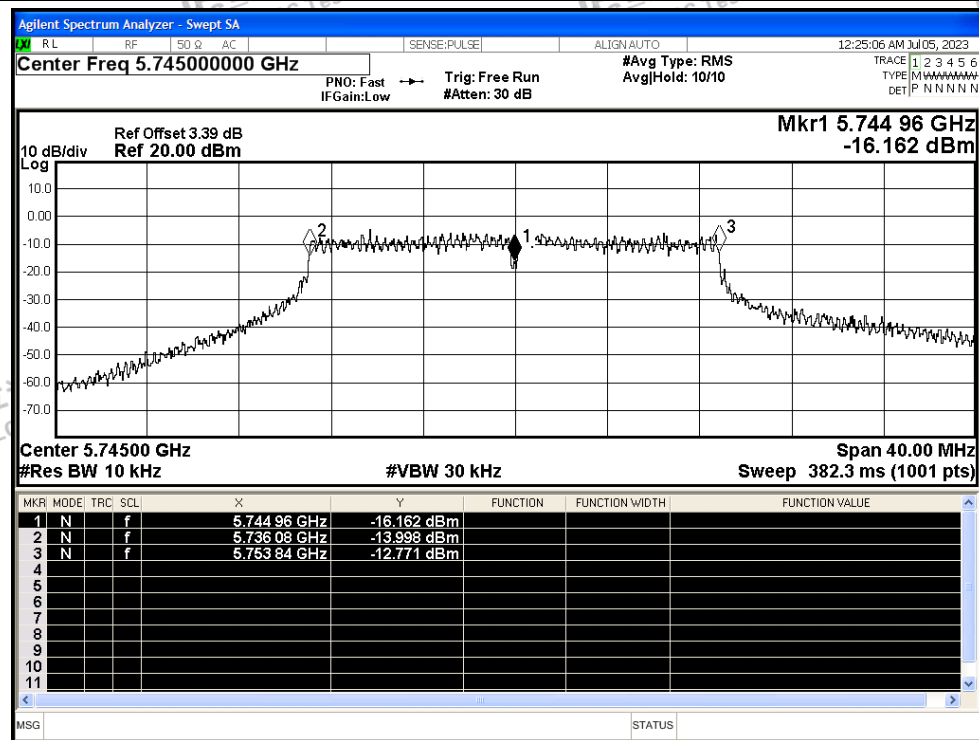


Freq. Stability NVNT ac20 5785MHz Ant2

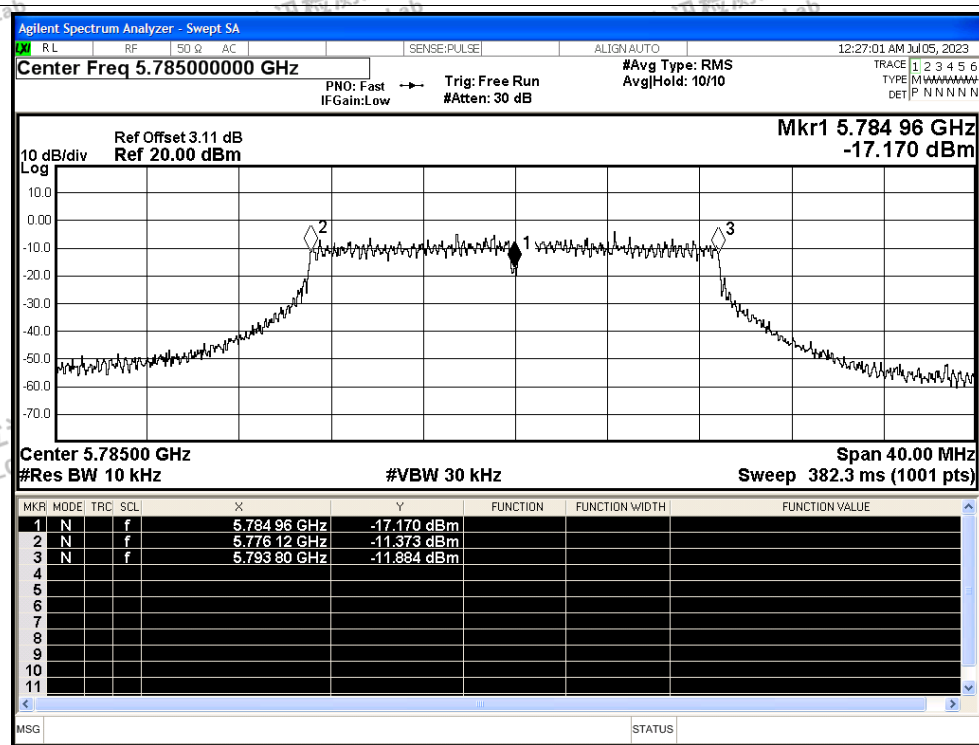




Freq. Stability NVNT ac20 5825MHz Ant2

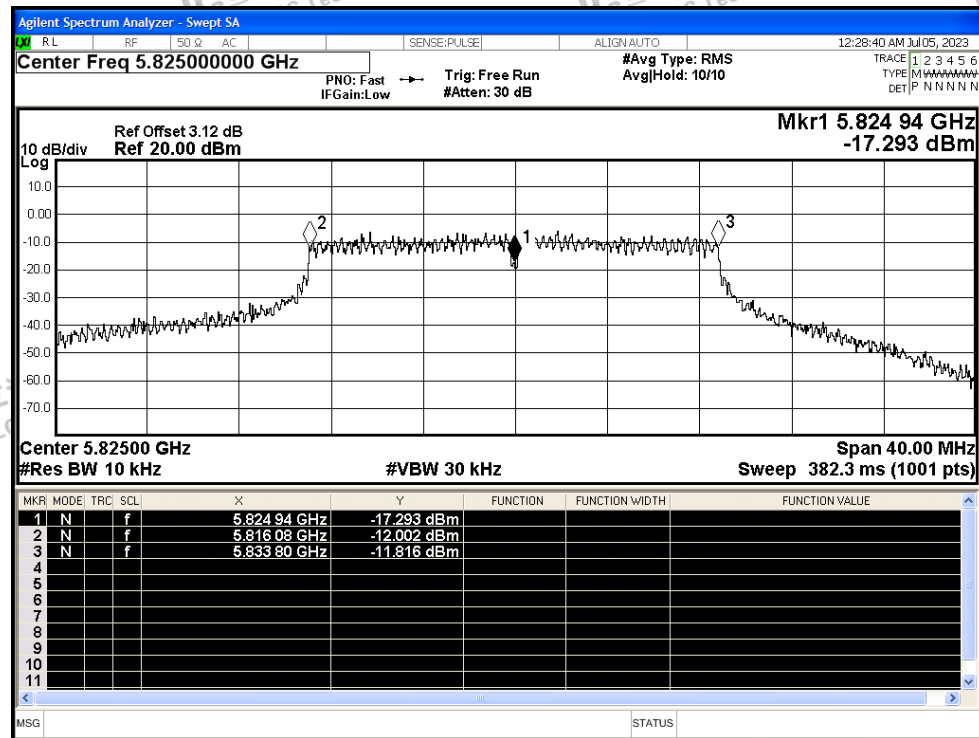


Freq. Stability NVNT ac40 5755MHz Ant2

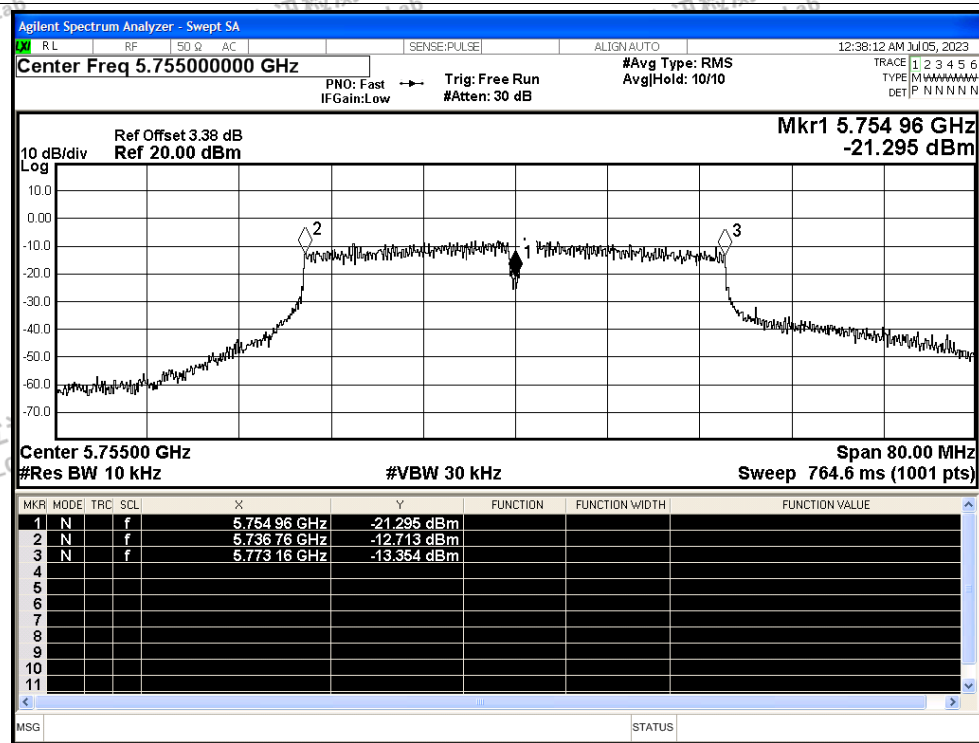




Freq. Stability NVNT ac40 5795MHz Ant2

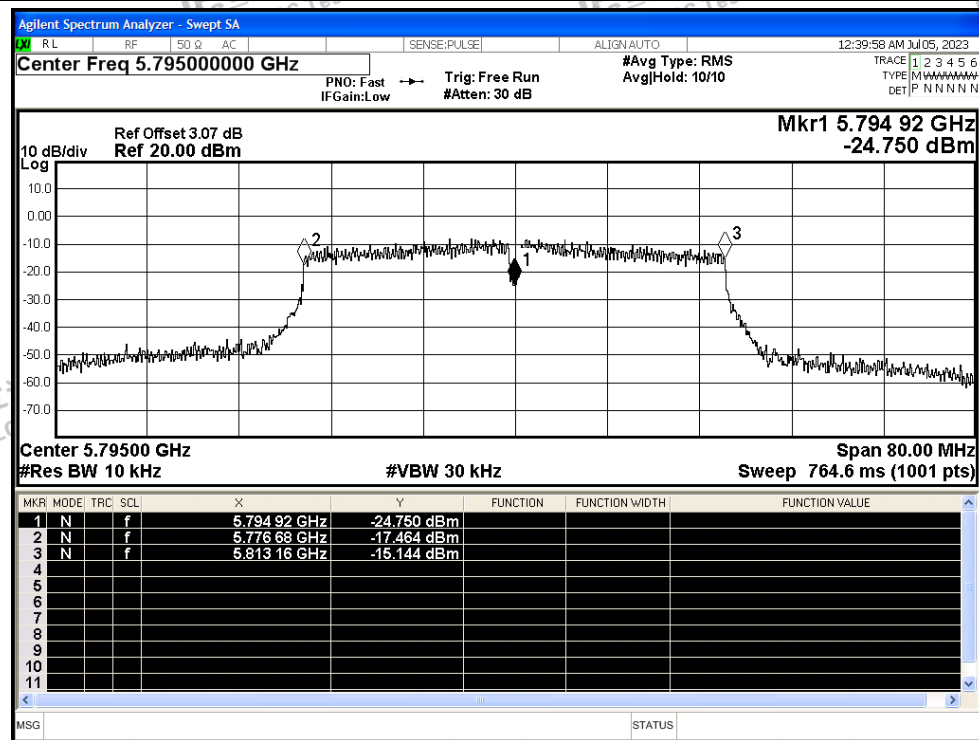

Freq. Stability NVNT ac80 5775MHz Ant2

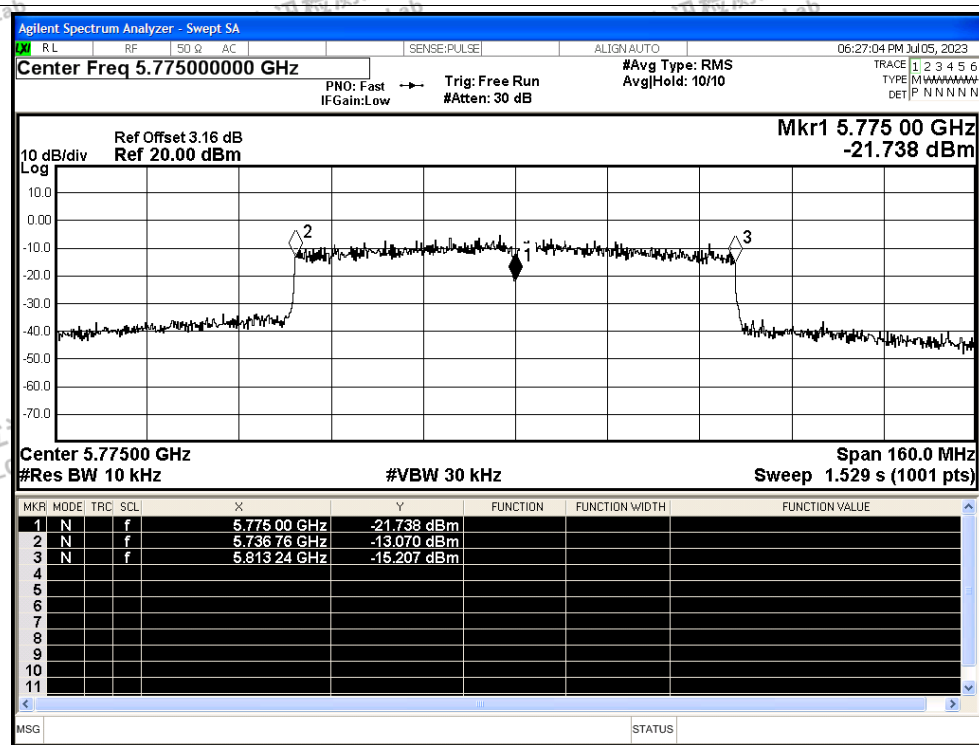



C.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant0	96.15	0.17	0.72
NVNT	a	5785	Ant0	96.08	0.17	0.72
NVNT	a	5825	Ant0	96.15	0.17	0.72
NVNT	n20	5745	Ant0	95.9	0.18	0.76
NVNT	n20	5785	Ant0	95.9	0.18	0.76
NVNT	n20	5825	Ant0	95.82	0.19	0.76
NVNT	n40	5755	Ant0	82.02	0.86	3.85
NVNT	n40	5795	Ant0	82.33	0.84	3.83
NVNT	ac20	5745	Ant0	89.39	0.49	2.08
NVNT	ac20	5785	Ant0	89.57	0.48	2.08
NVNT	ac20	5825	Ant0	89.57	0.48	2.08
NVNT	ac40	5755	Ant0	82.02	0.86	3.85
NVNT	ac40	5795	Ant0	82.28	0.85	3.85
NVNT	ac80	5775	Ant0	72.68	1.39	6.71
NVNT	ax20	5745	Ant0	87.28	0.59	2.56
NVNT	ax20	5785	Ant0	87.47	0.58	2.56
NVNT	ax20	5825	Ant0	87.28	0.59	2.56
NVNT	ax40	5755	Ant0	80.56	0.94	4.31
NVNT	ax40	5795	Ant0	80.56	0.94	4.31
NVNT	ax80	5775	Ant0	71.92	1.43	6.85




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5745MHz Ant0

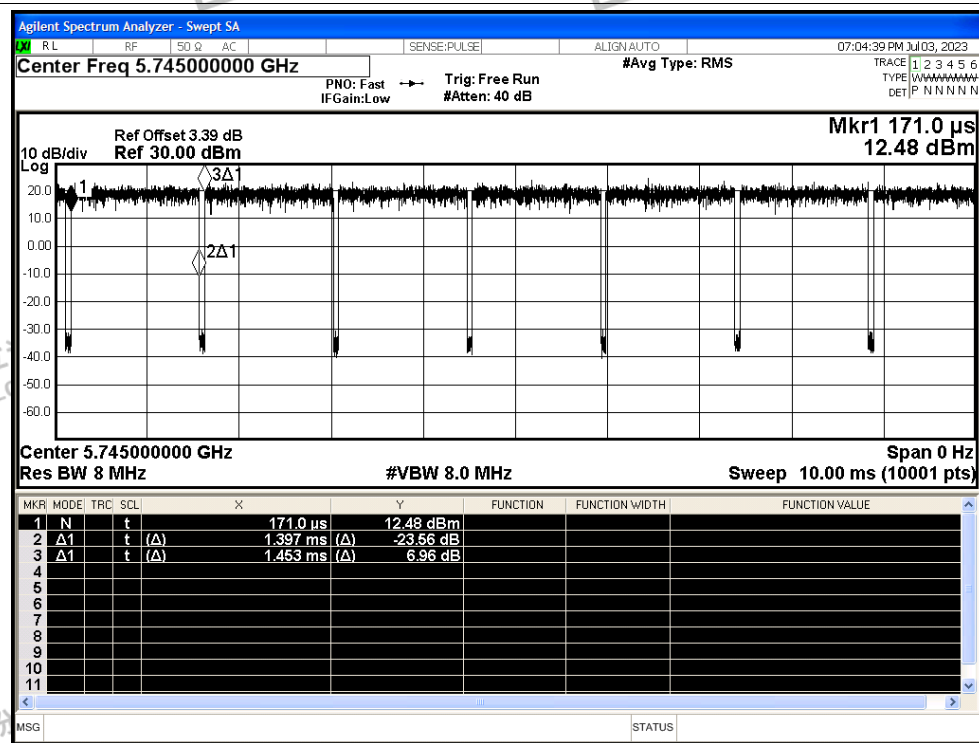

Duty Cycle NVNT a 5785MHz Ant0

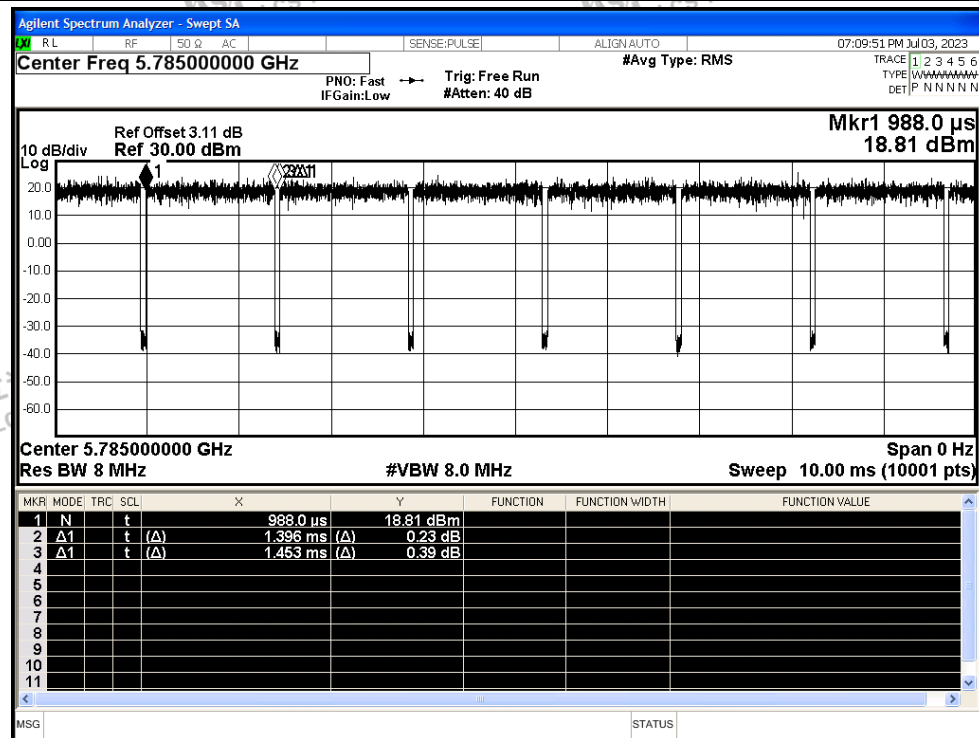

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5825MHz Ant0

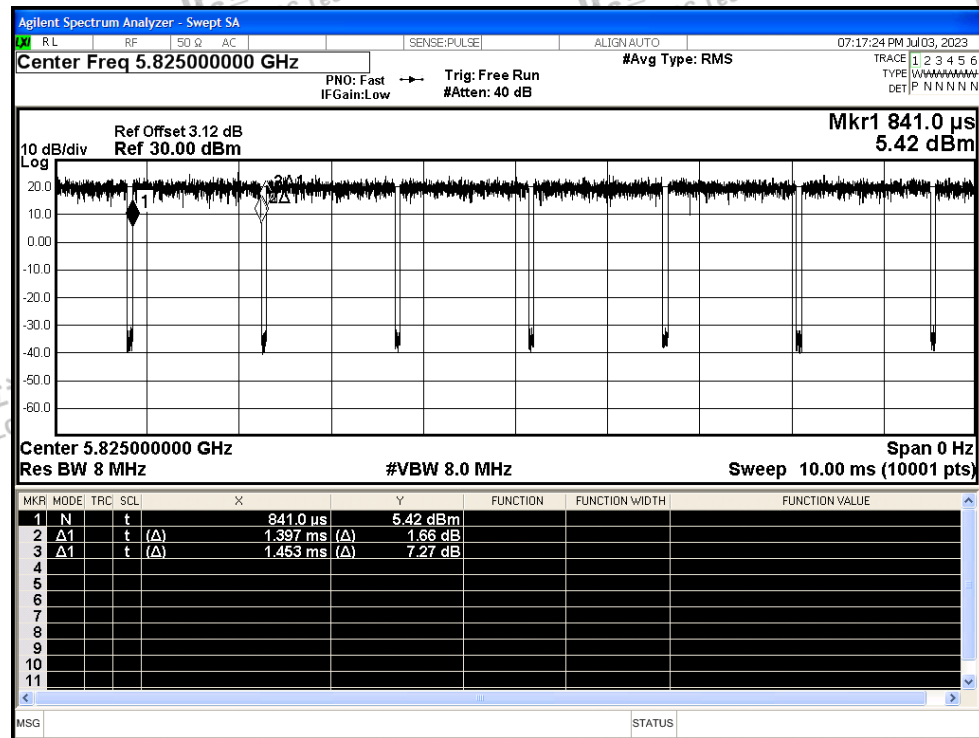

Duty Cycle NVNT n20 5745MHz Ant0

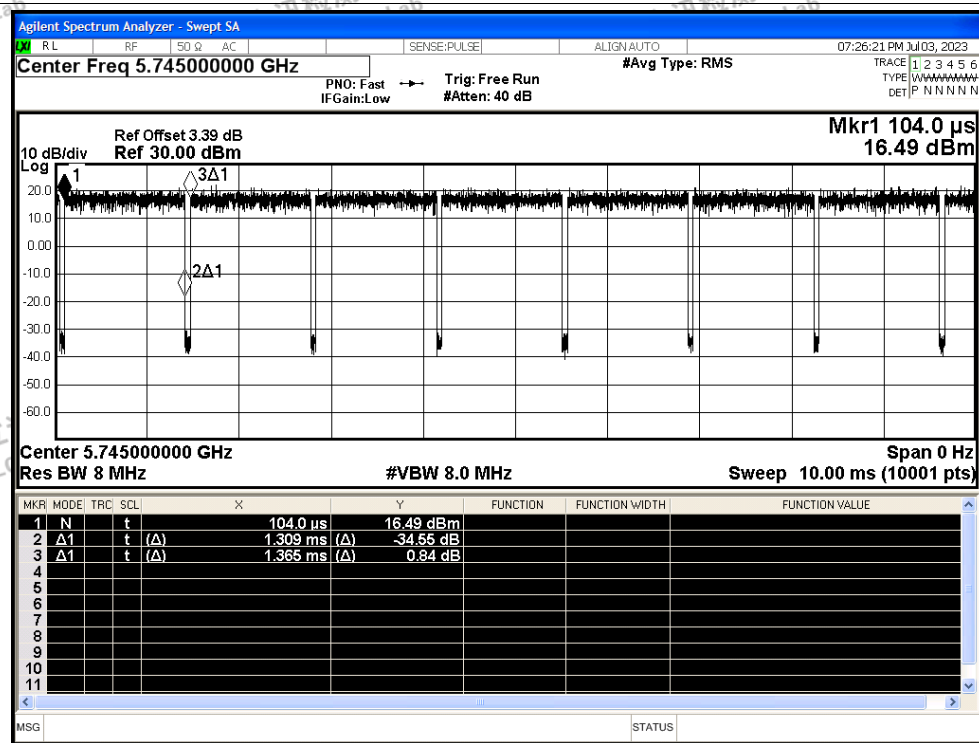

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5785MHz Ant0

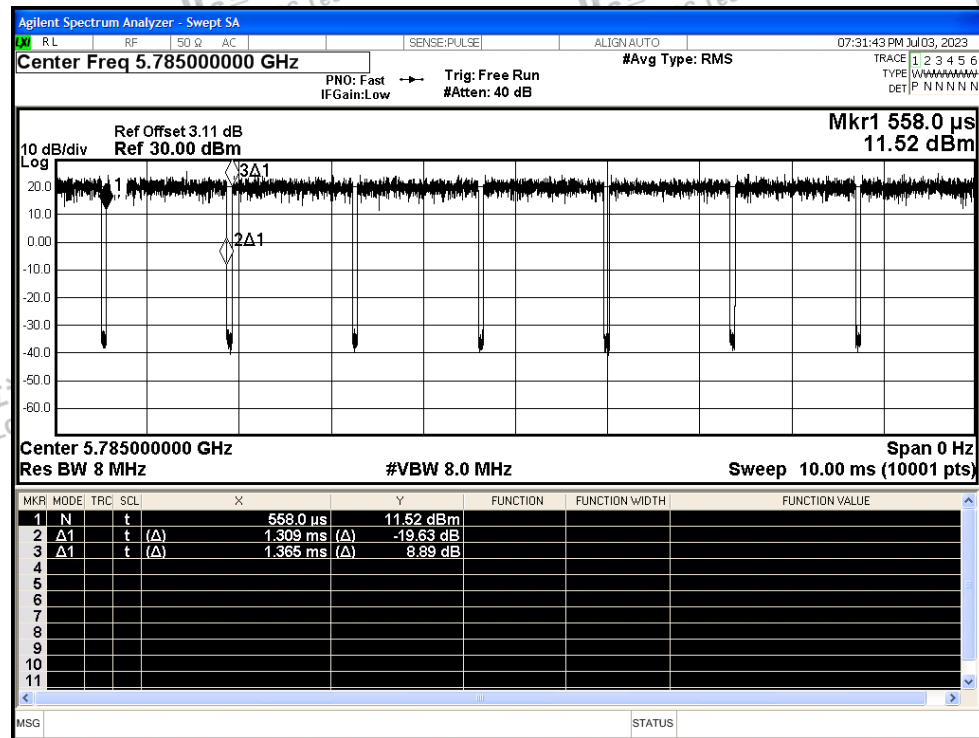


Duty Cycle NVNT n20 5825MHz Ant0

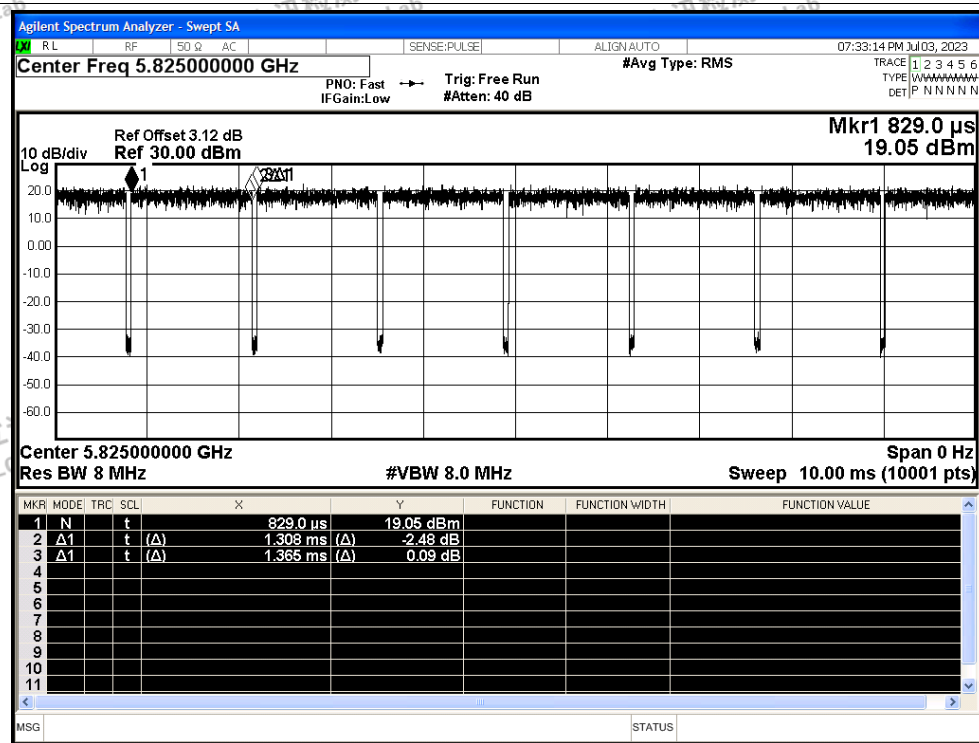




Duty Cycle NVNT n40 5755MHz Ant0

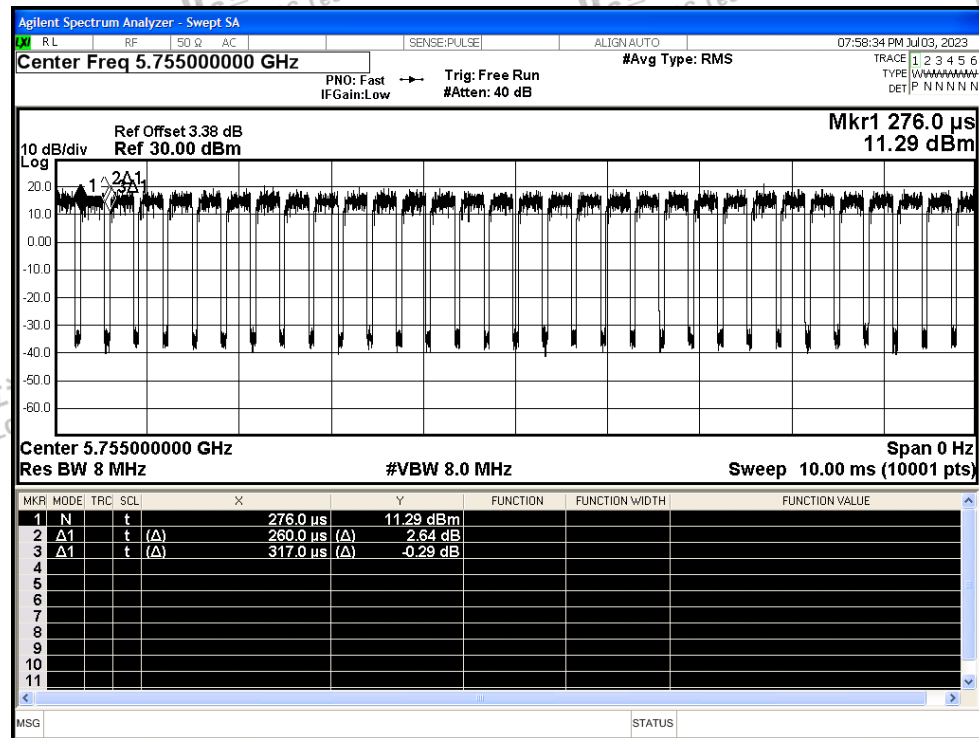


Duty Cycle NVNT n40 5795MHz Ant0

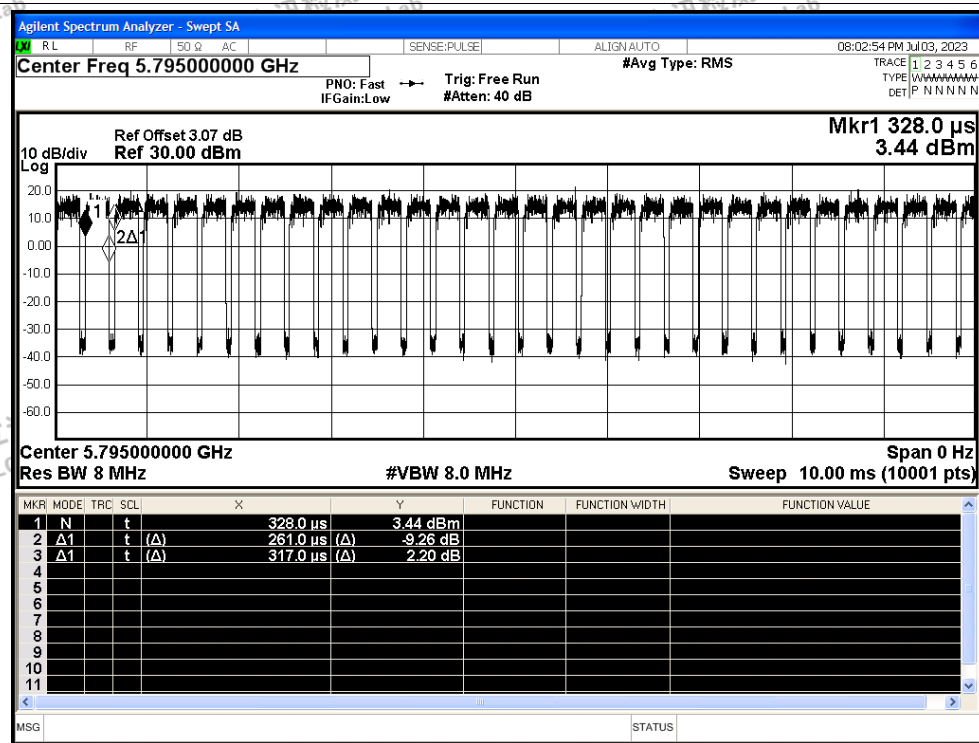




Duty Cycle NVNT ac20 5745MHz Ant0

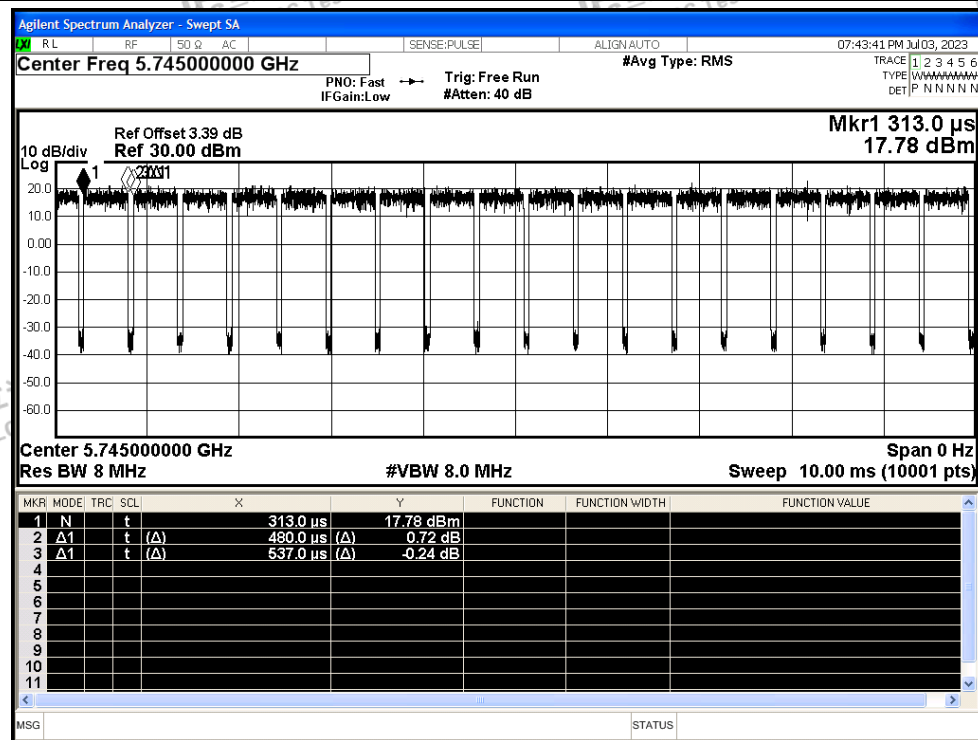

Duty Cycle NVNT ac20 5785MHz Ant0

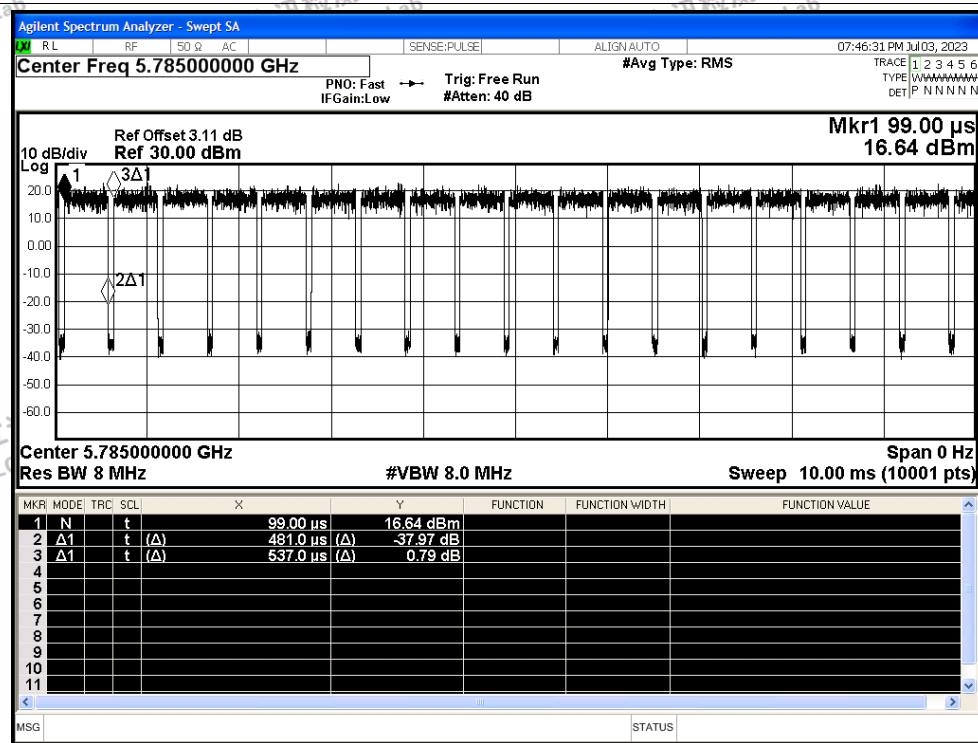

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5825MHz Ant0

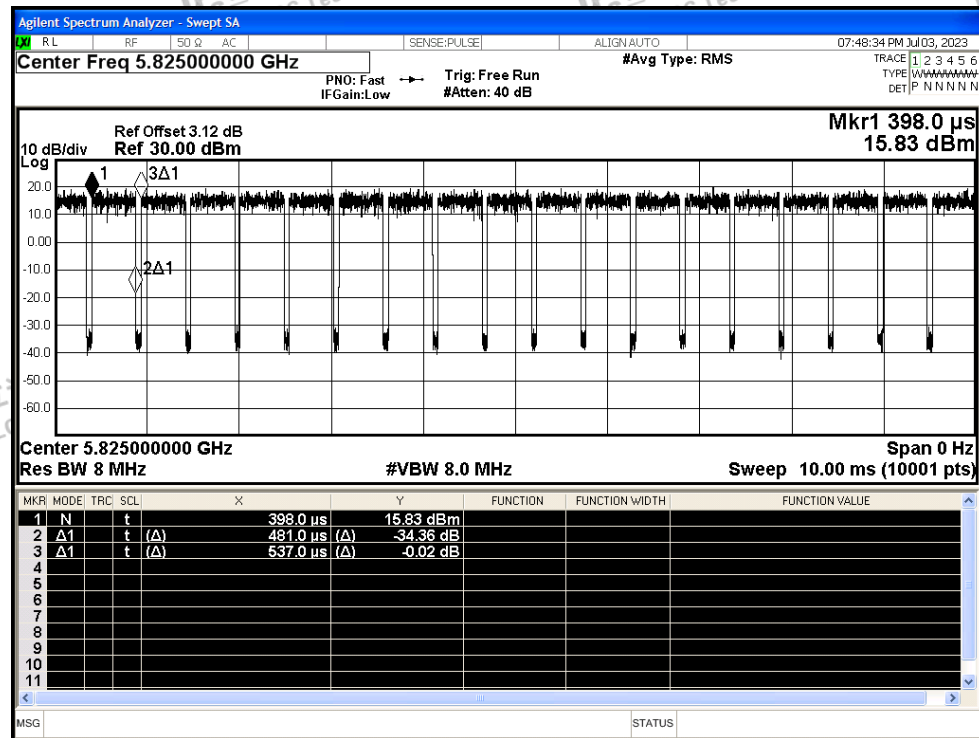


Duty Cycle NVNT ac40 5755MHz Ant0

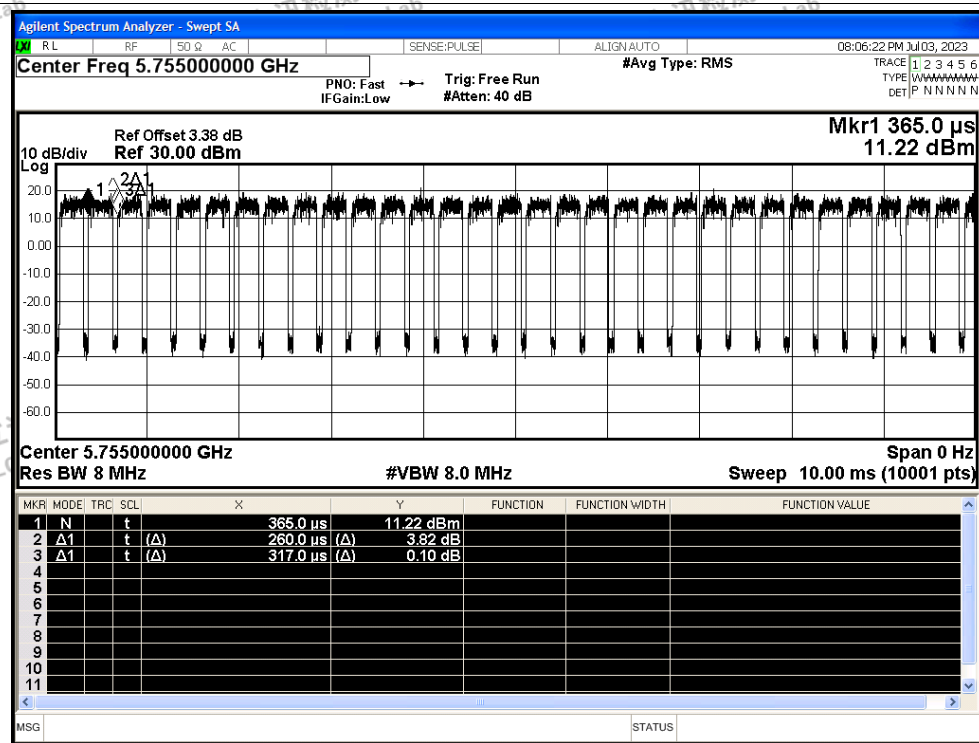




Duty Cycle NVNT ac40 5795MHz Ant0

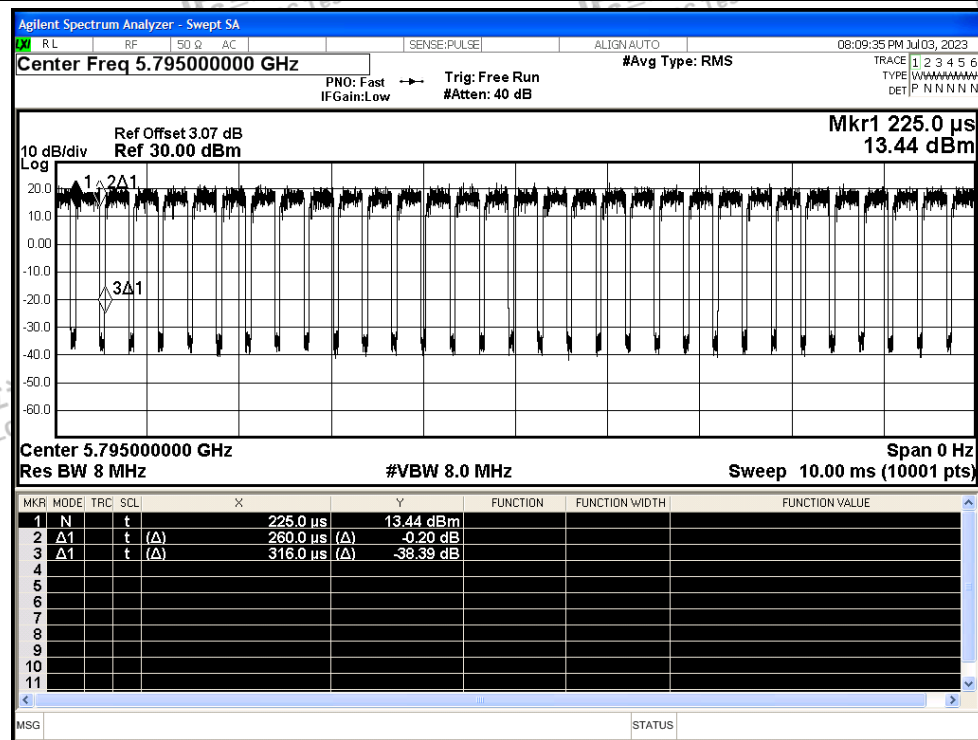

Duty Cycle NVNT ac80 5775MHz Ant0

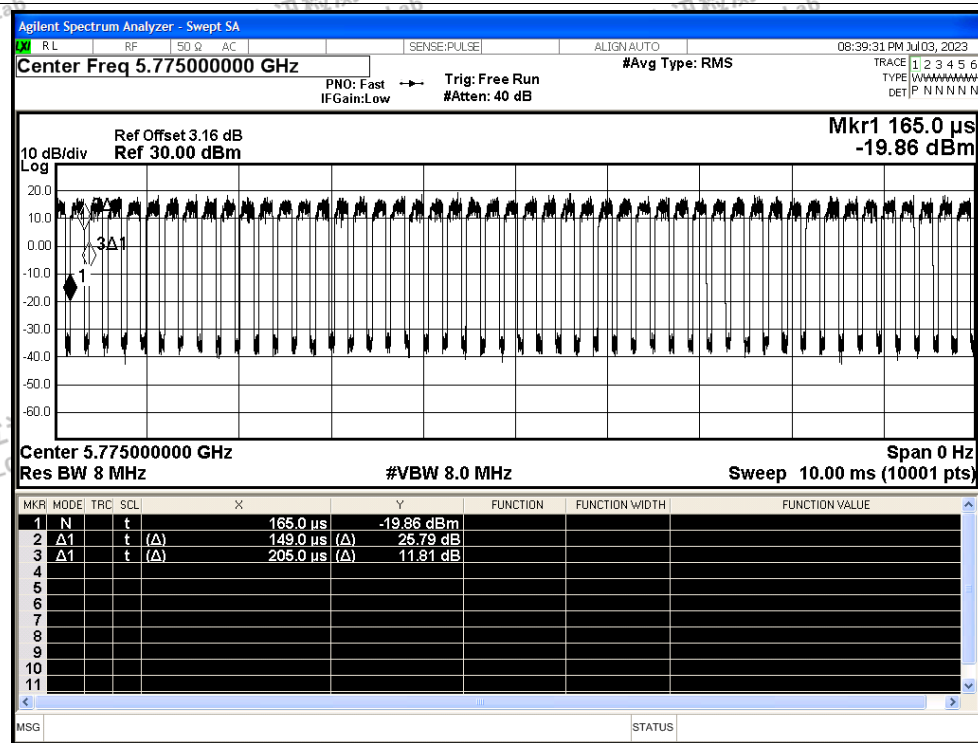

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5745MHz Ant0

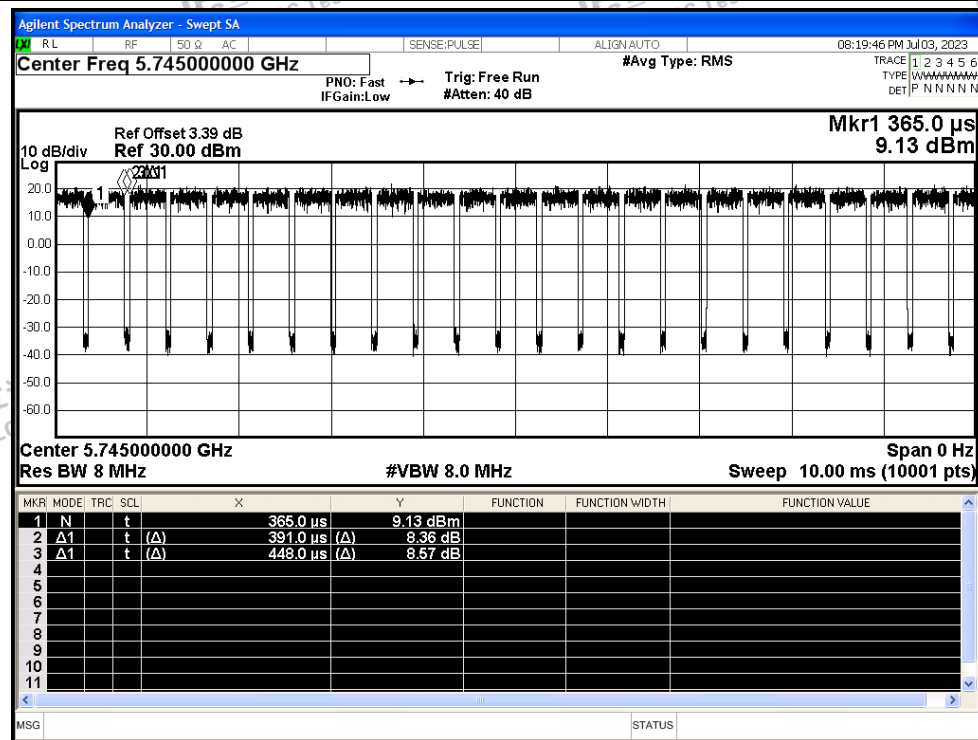


Duty Cycle NVNT ax20 5785MHz Ant0

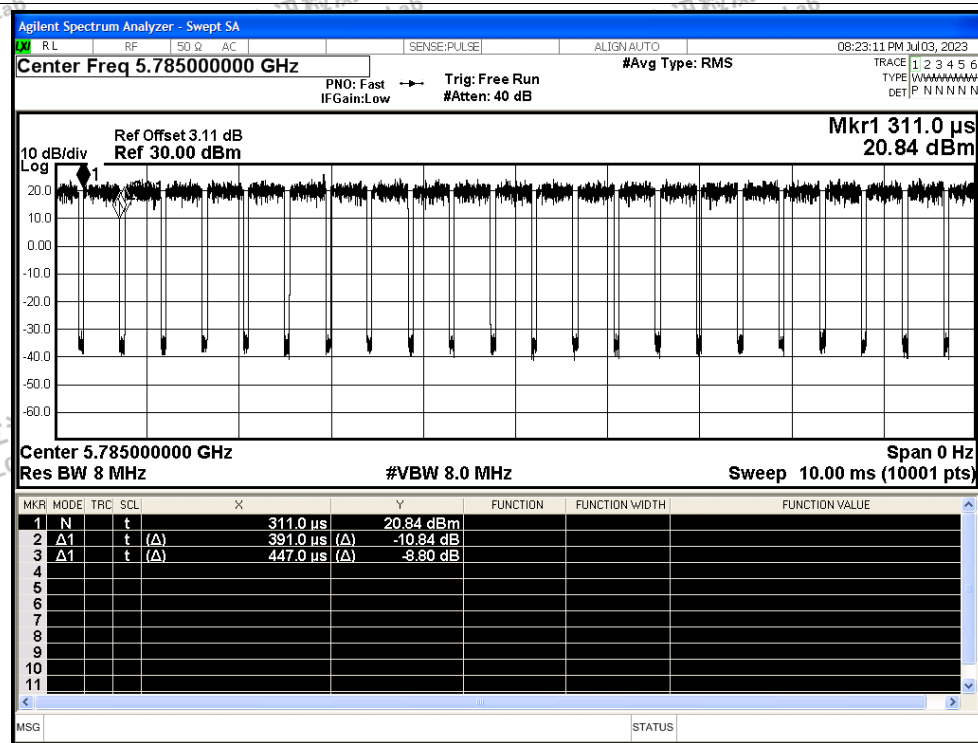




Duty Cycle NVNT ax20 5825MHz Ant0

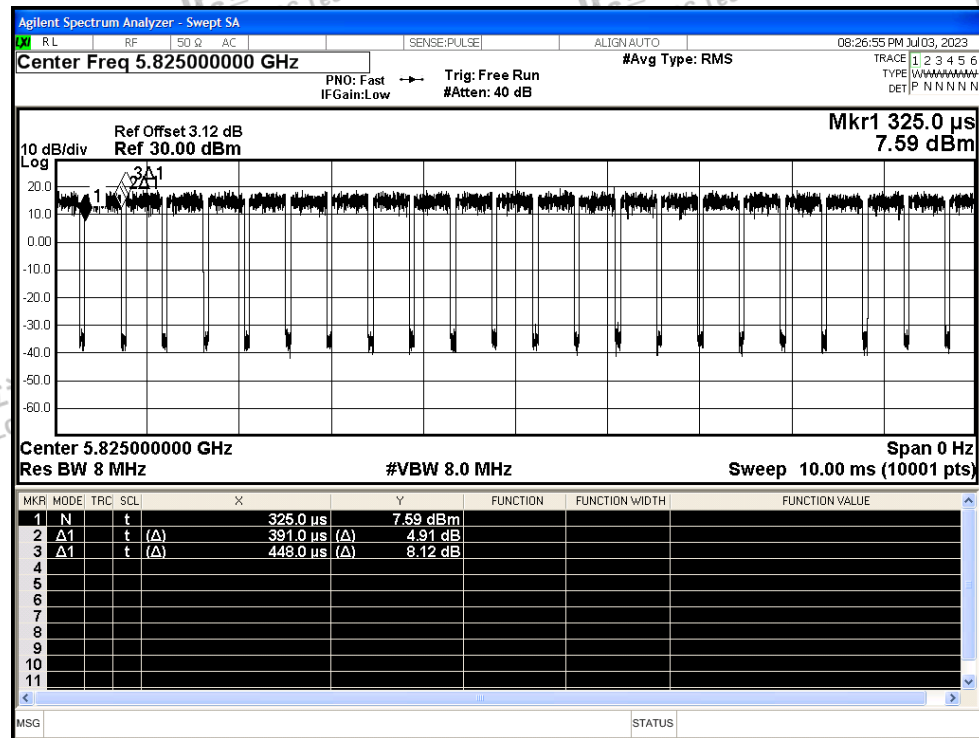

Duty Cycle NVNT ax40 5755MHz Ant0

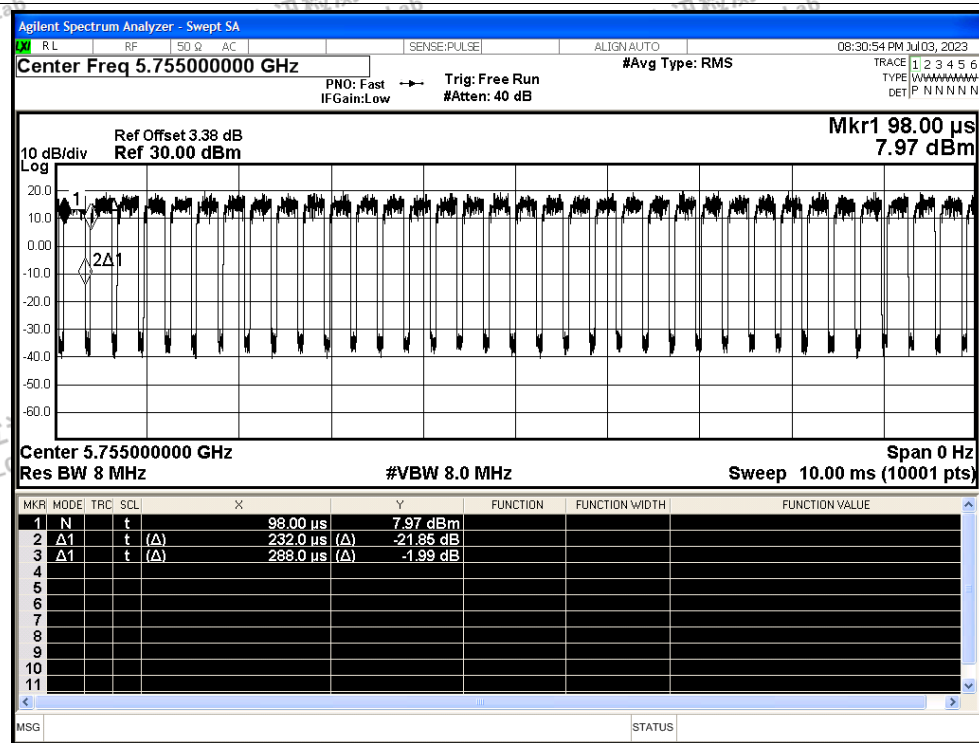

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5795MHz Ant0

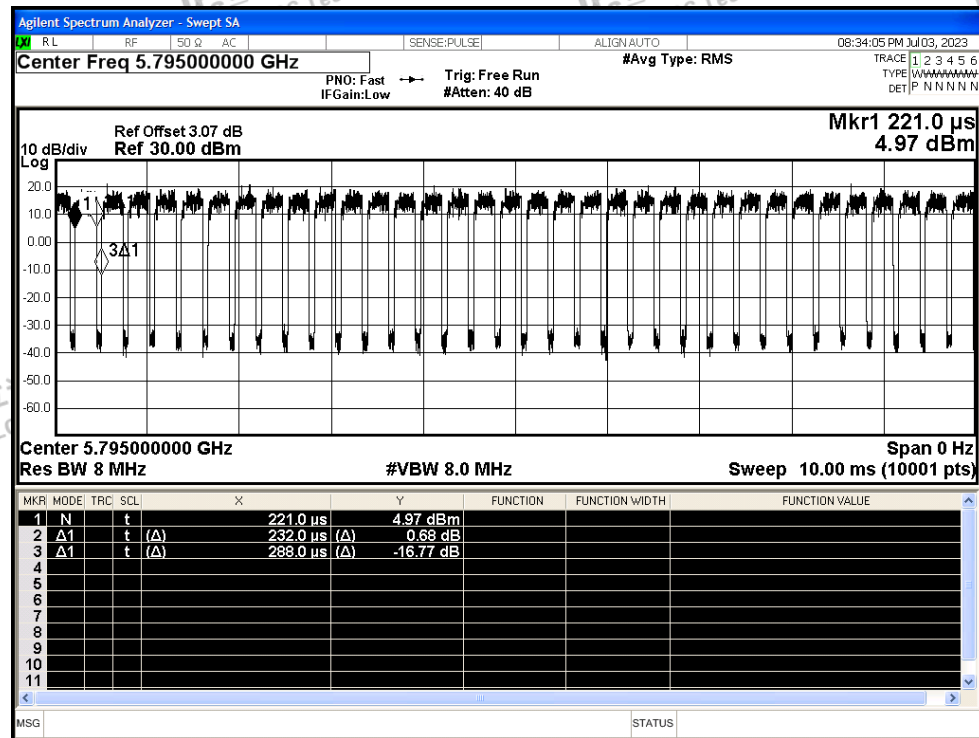

Duty Cycle NVNT ax80 5775MHz Ant0

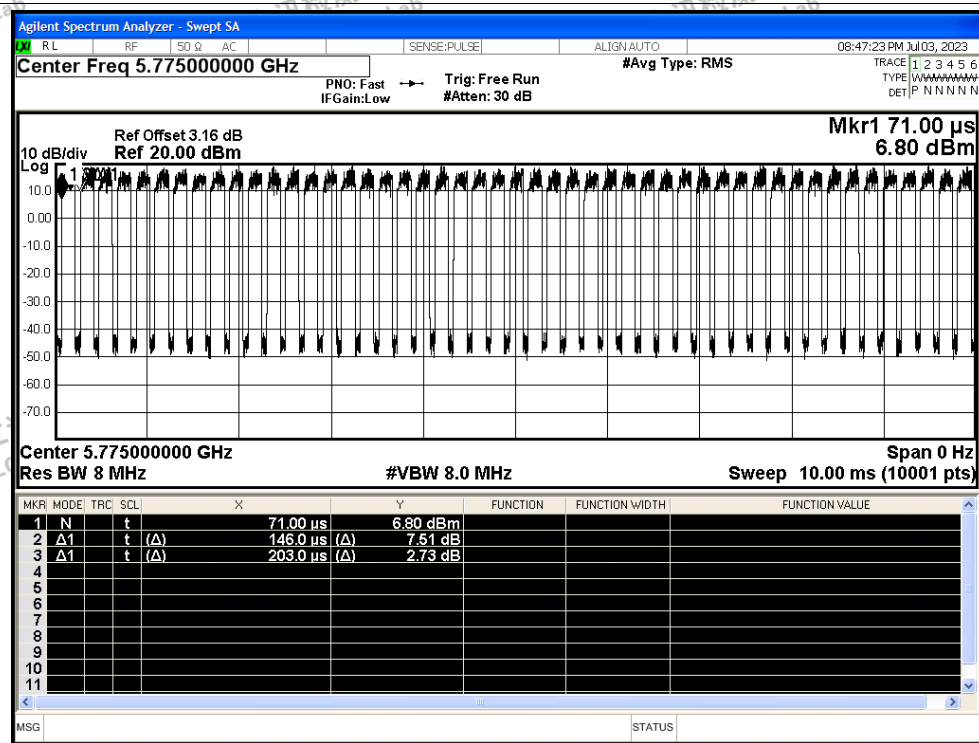

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant1	96.15	0.17	0.72
NVNT	a	5785	Ant1	96.15	0.17	0.72
NVNT	a	5825	Ant1	96.08	0.17	0.72
NVNT	n20	5745	Ant1	95.88	0.18	0.77
NVNT	n20	5785	Ant1	95.89	0.18	0.77
NVNT	n20	5825	Ant1	95.81	0.19	0.77
NVNT	n40	5755	Ant1	82.02	0.86	3.85
NVNT	n40	5795	Ant1	82.33	0.84	3.83
NVNT	ac20	5745	Ant1	89.55	0.48	2.08
NVNT	ac20	5785	Ant1	89.39	0.49	2.08
NVNT	ac20	5825	Ant1	89.39	0.49	2.08
NVNT	ac40	5755	Ant1	82.33	0.84	3.83
NVNT	ac40	5795	Ant1	82.02	0.86	3.85
NVNT	ac80	5775	Ant1	52.89	2.77	15.62
NVNT	ax20	5745	Ant1	87.28	0.59	2.56
NVNT	ax20	5785	Ant1	87.47	0.58	2.56
NVNT	ax20	5825	Ant1	87.47	0.58	2.56
NVNT	ax40	5755	Ant1	80.56	0.94	4.31
NVNT	ax40	5795	Ant1	80.56	0.94	4.31
NVNT	ax80	5775	Ant1	58.21	2.35	12.82




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5745MHz Ant1

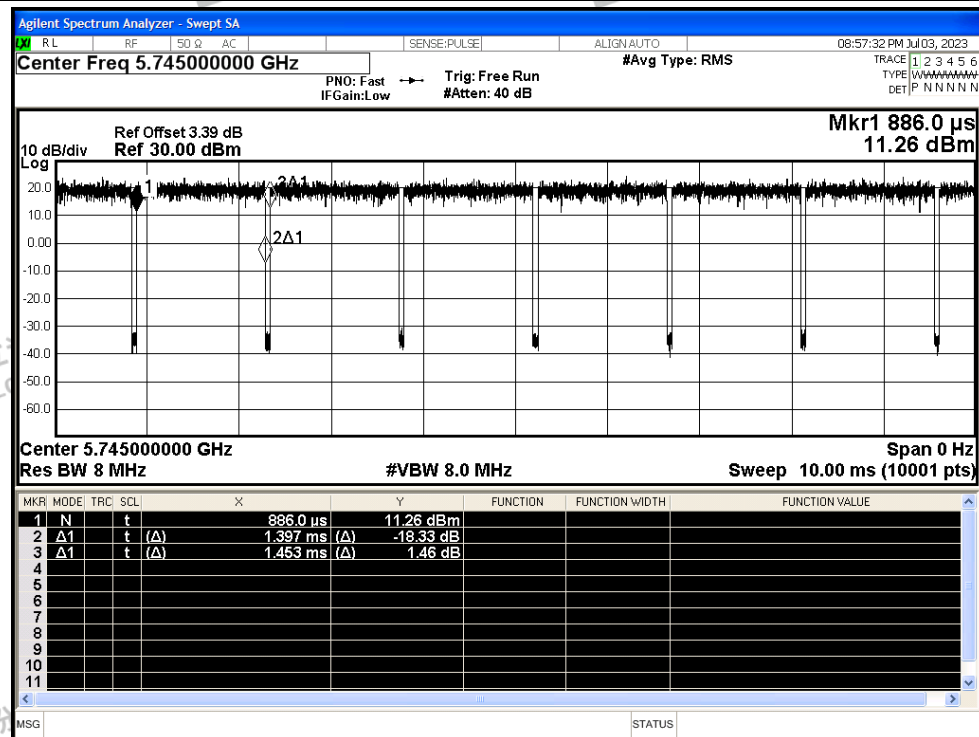


Duty Cycle NVNT a 5785MHz Ant1

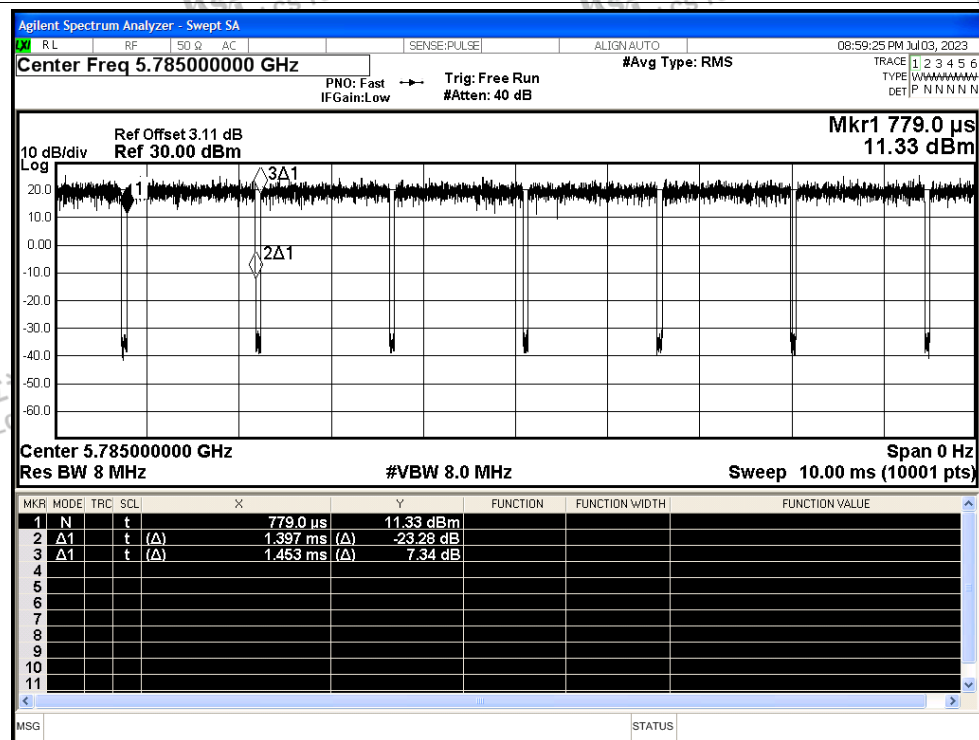




Duty Cycle NVNT a 5825MHz Ant1

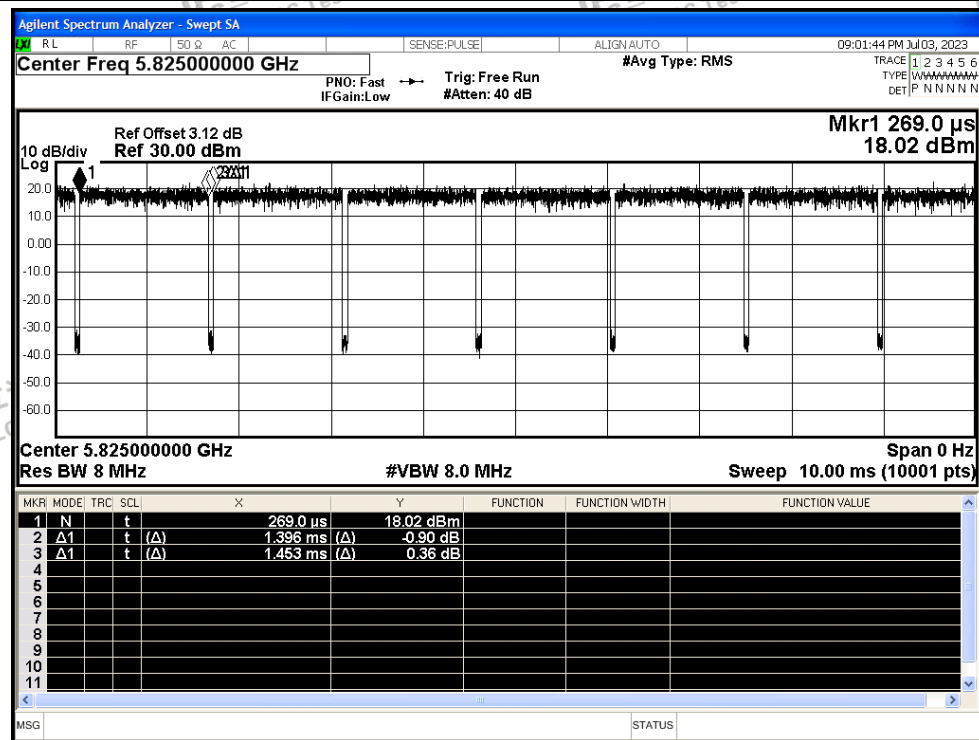


Duty Cycle NVNT n20 5745MHz Ant1

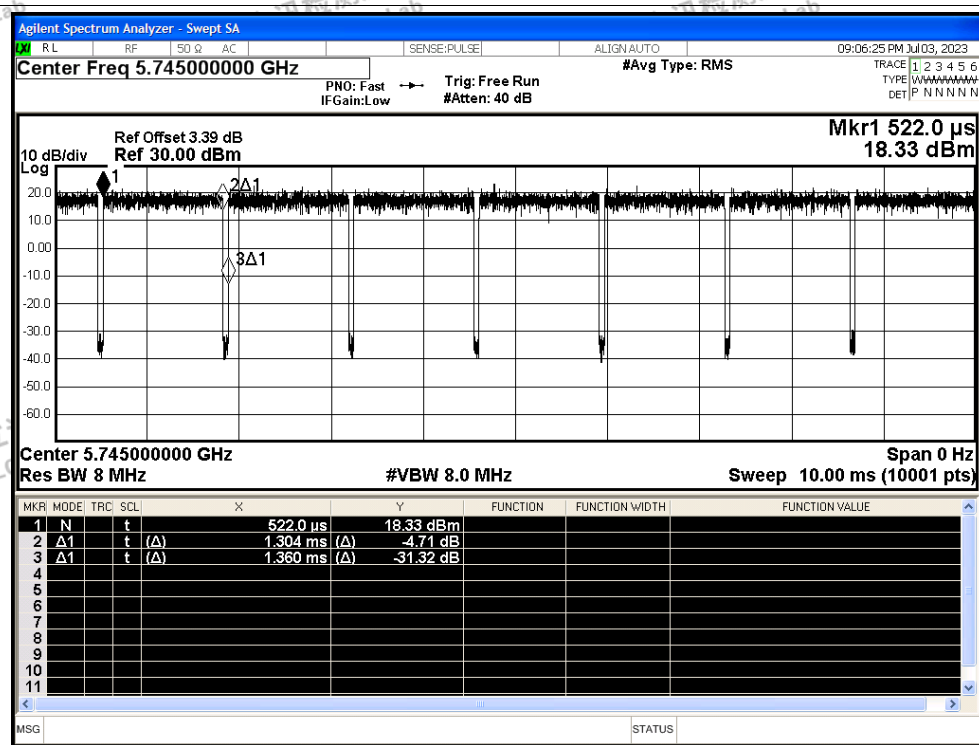




Duty Cycle NVNT n20 5785MHz Ant1

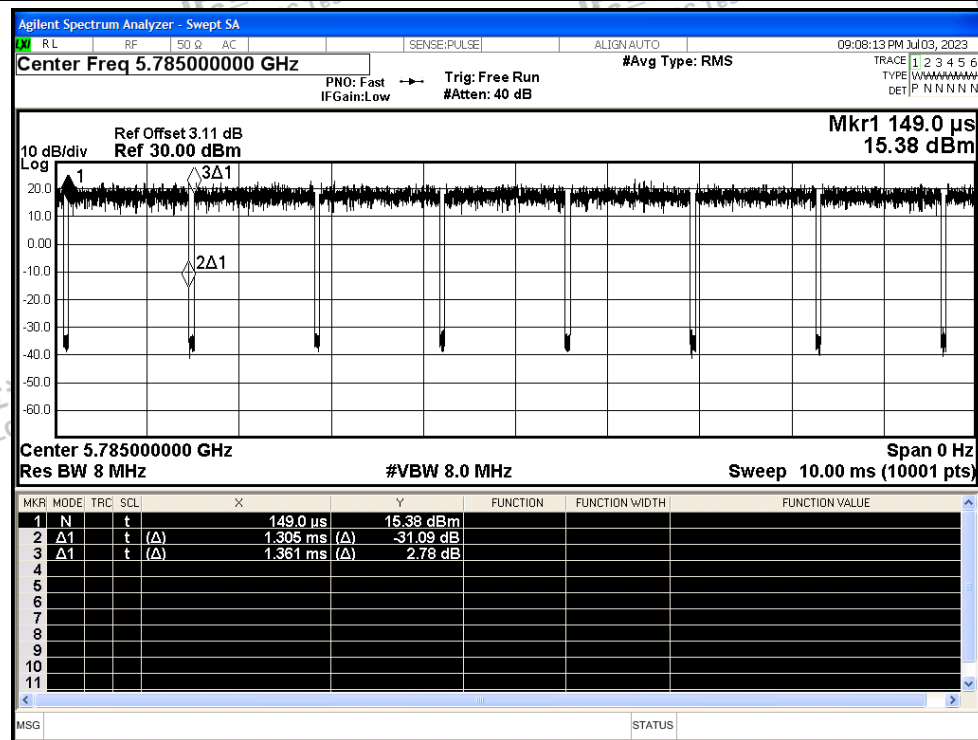

Duty Cycle NVNT n20 5825MHz Ant1

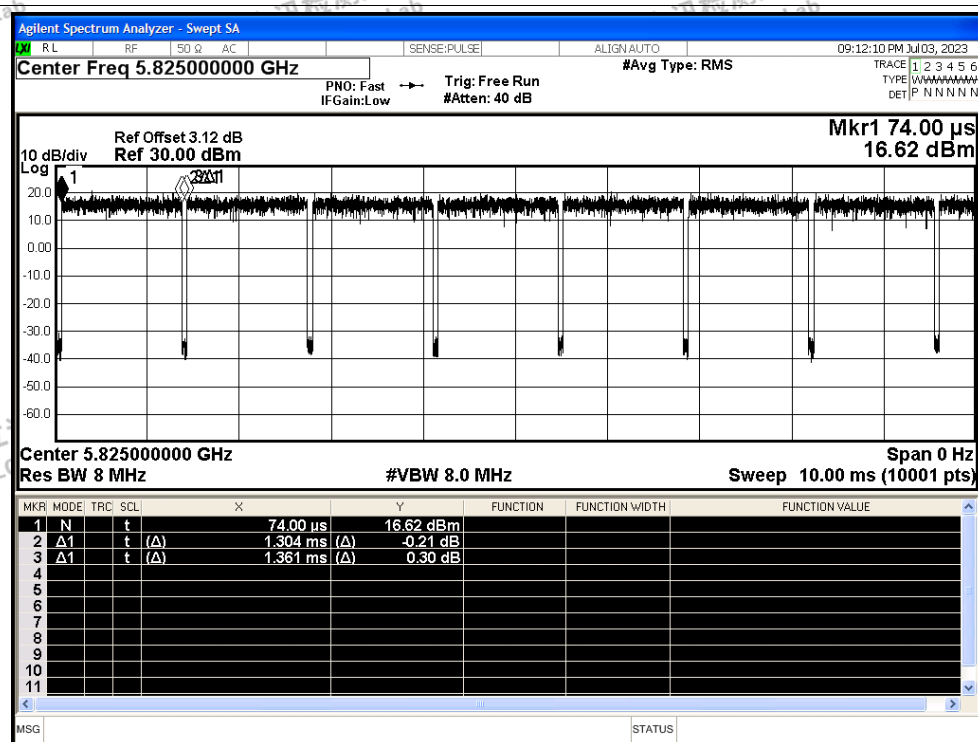

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5755MHz Ant1

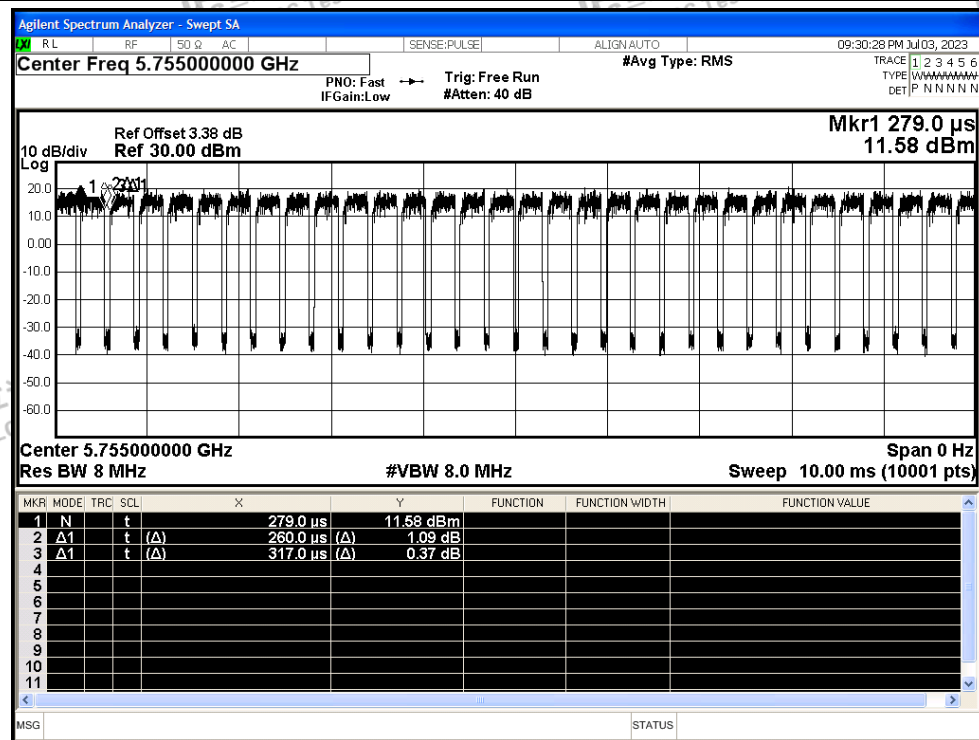


Duty Cycle NVNT n40 5795MHz Ant1

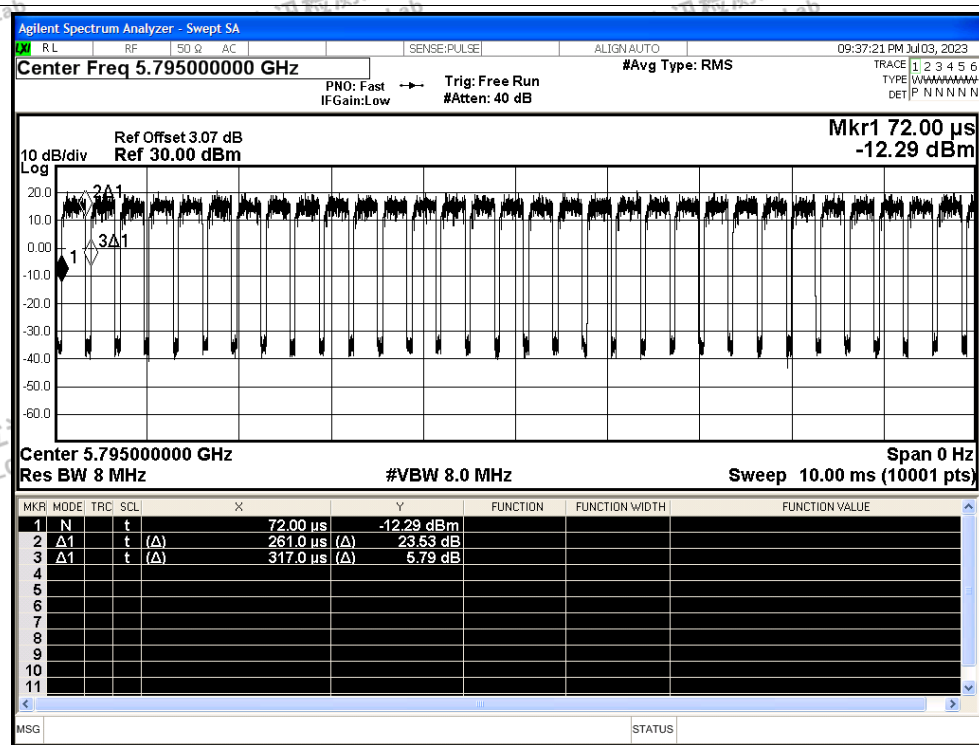




Duty Cycle NVNT ac20 5745MHz Ant1

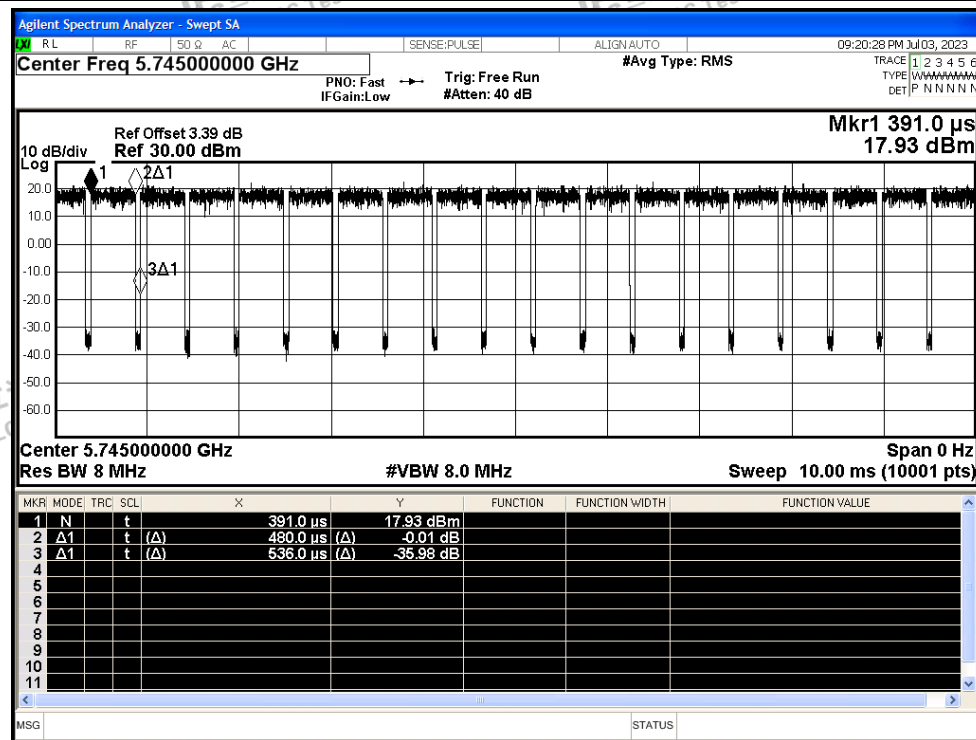

Duty Cycle NVNT ac20 5785MHz Ant1

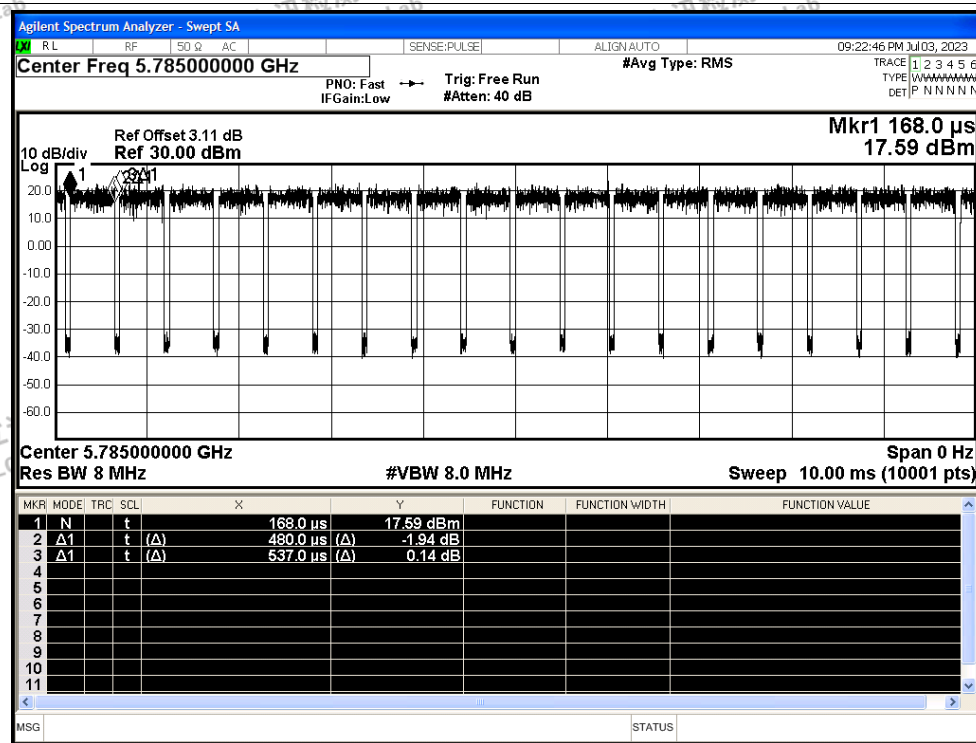

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5825MHz Ant1

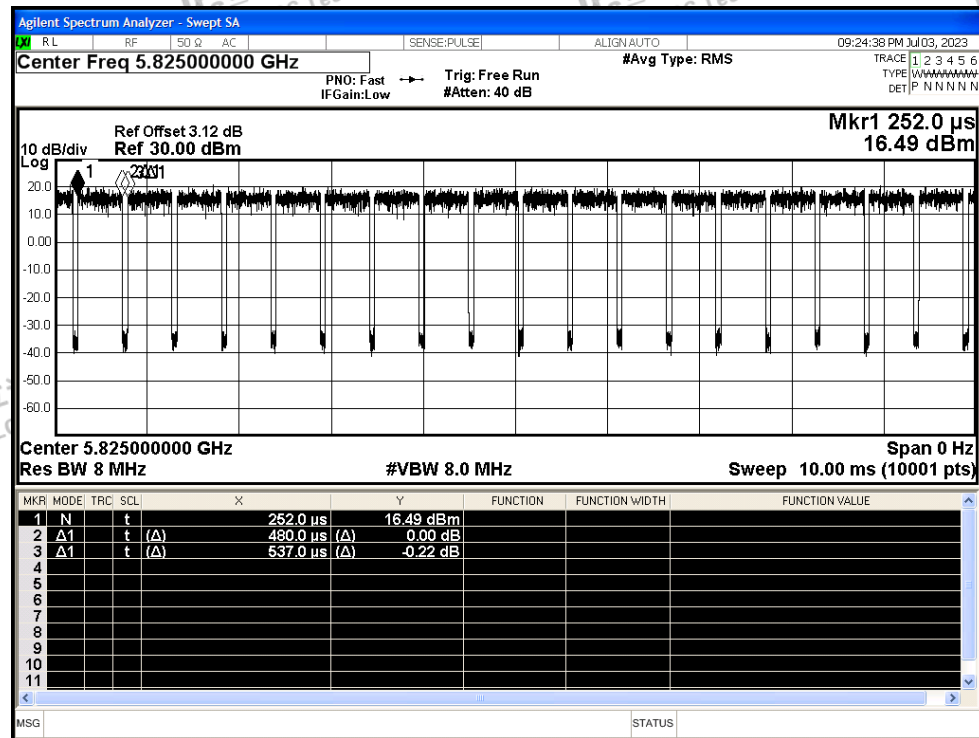


Duty Cycle NVNT ac40 5755MHz Ant1

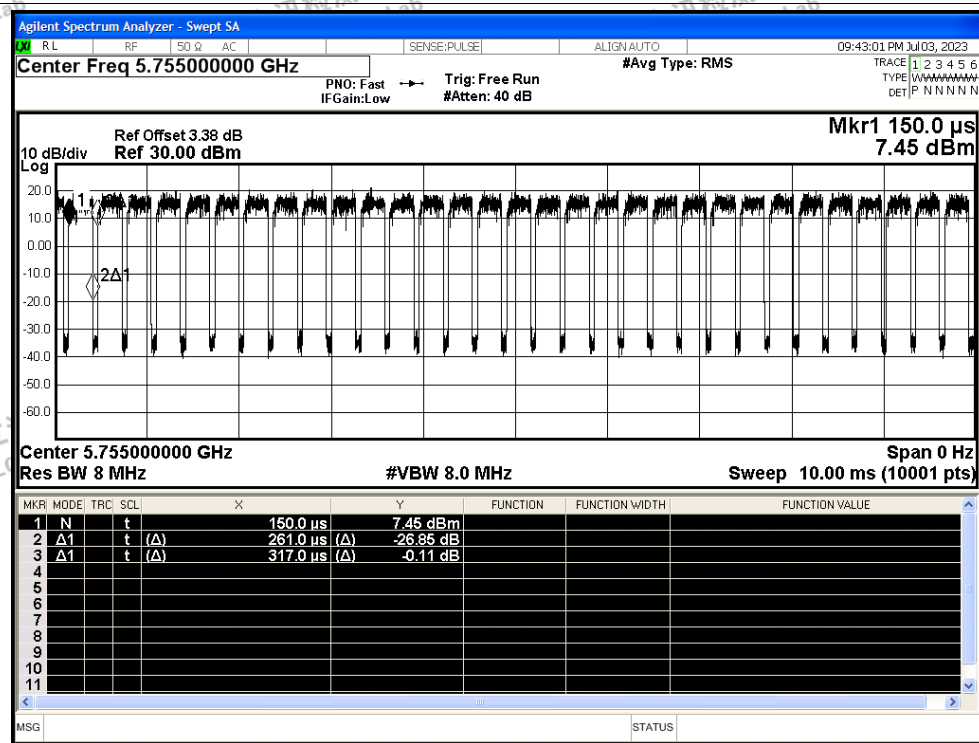




Duty Cycle NVNT ac40 5795MHz Ant1

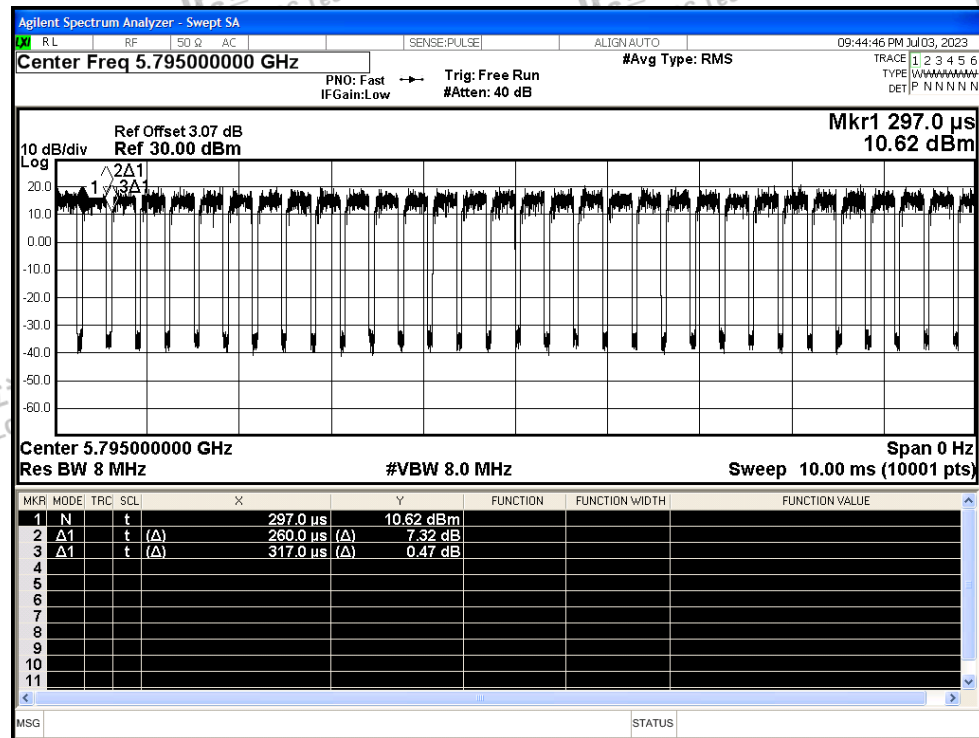


Duty Cycle NVNT ac80 5775MHz Ant1

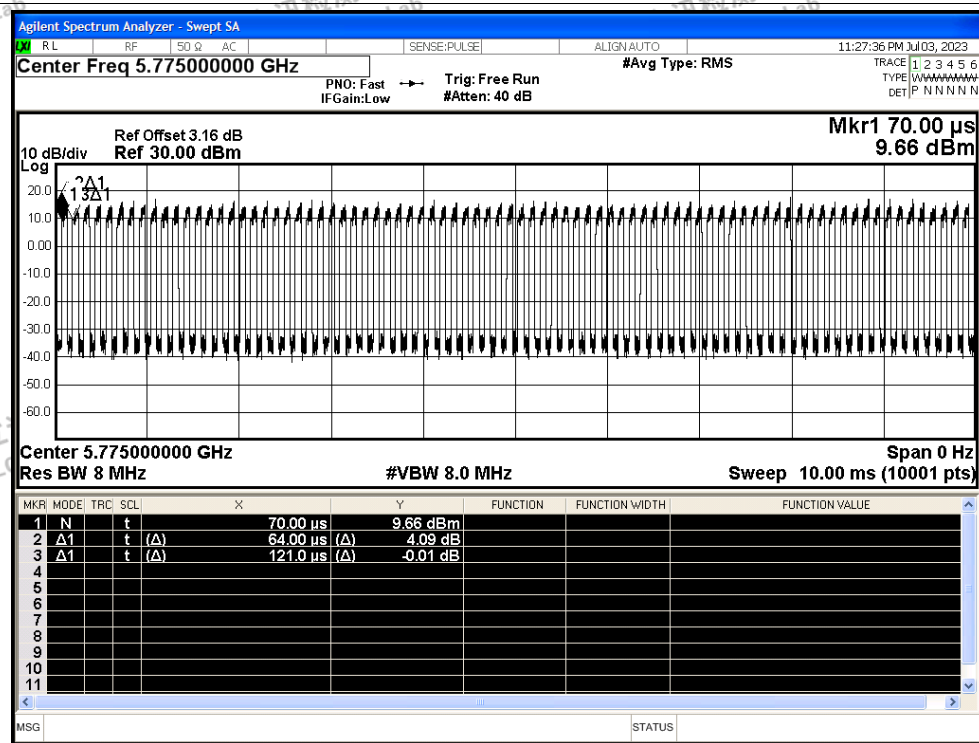




Duty Cycle NVNT ax20 5745MHz Ant1

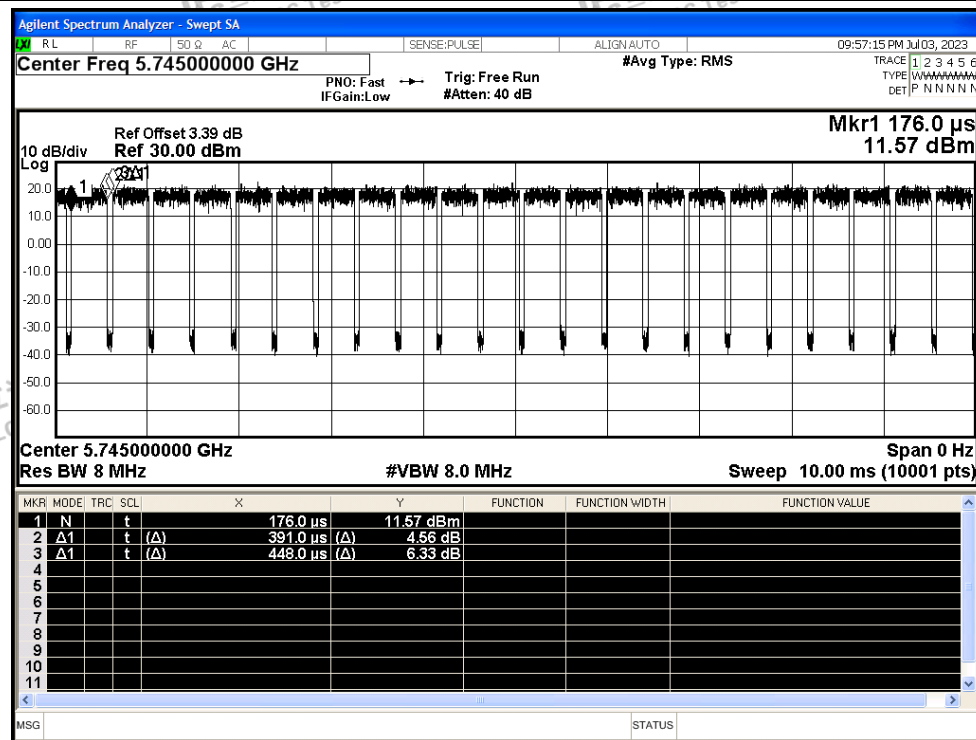


Duty Cycle NVNT ax20 5785MHz Ant1

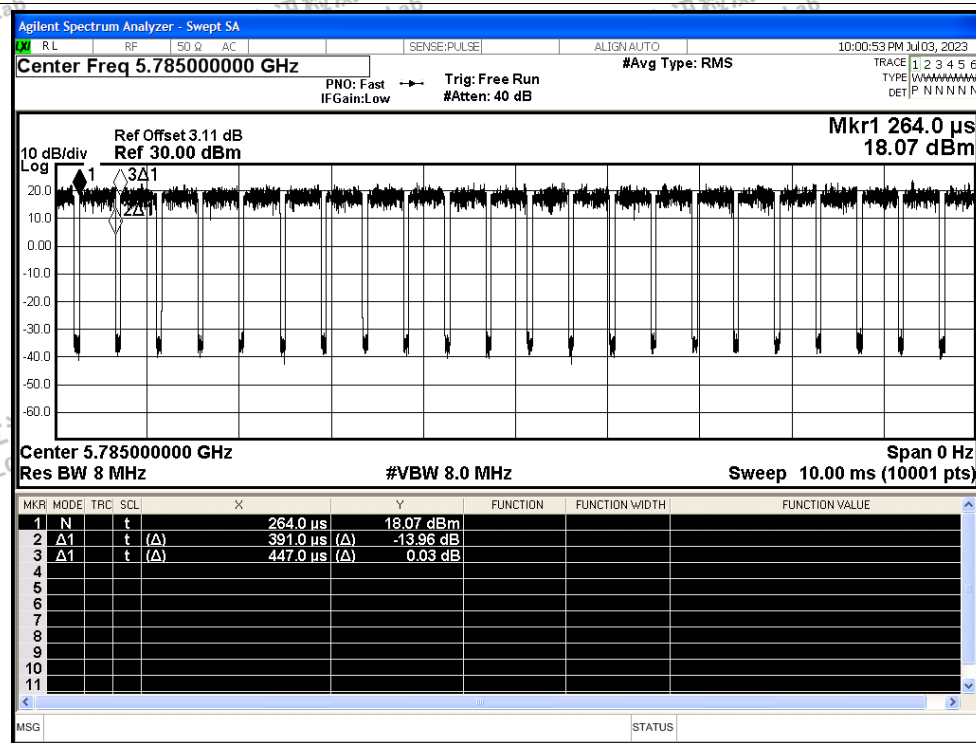




Duty Cycle NVNT ax20 5825MHz Ant1

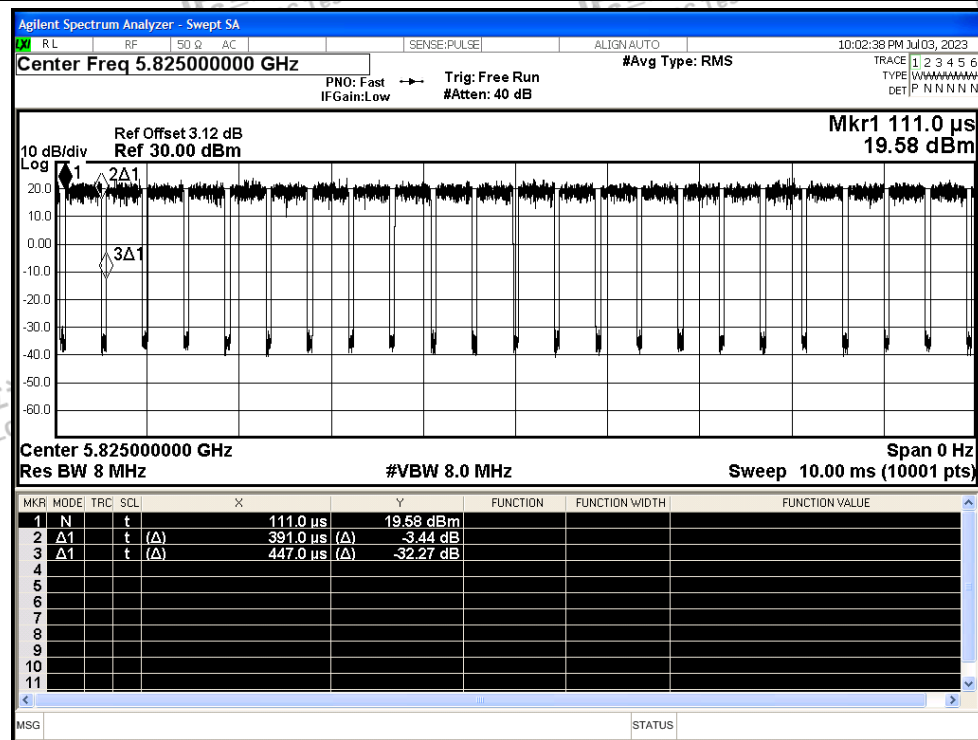


Duty Cycle NVNT ax40 5755MHz Ant1

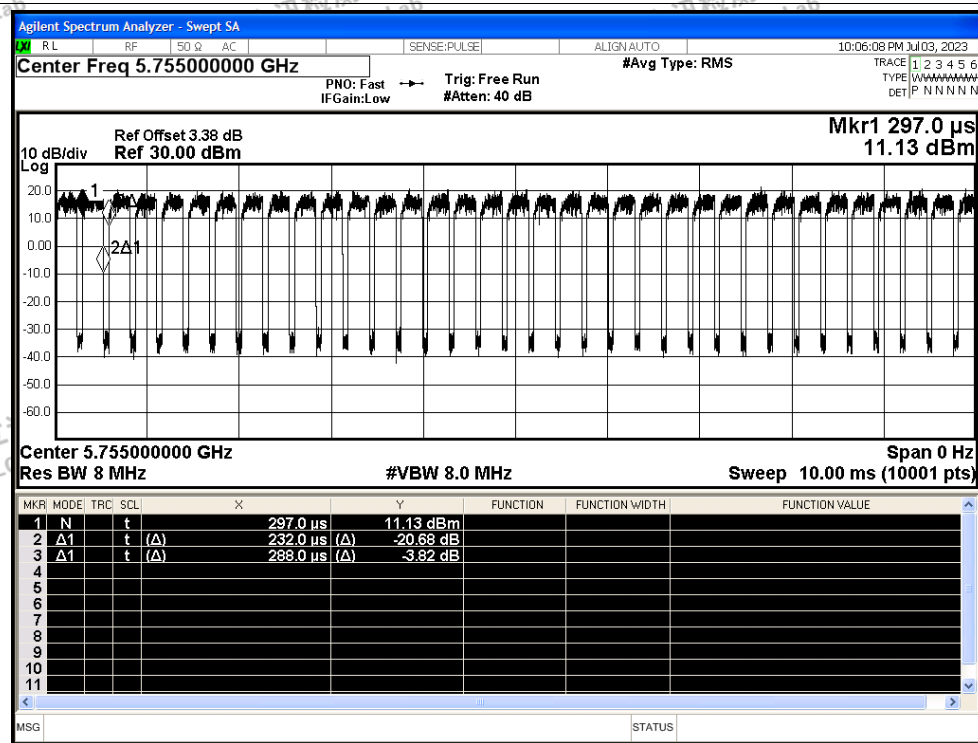




Duty Cycle NVNT ax40 5795MHz Ant1

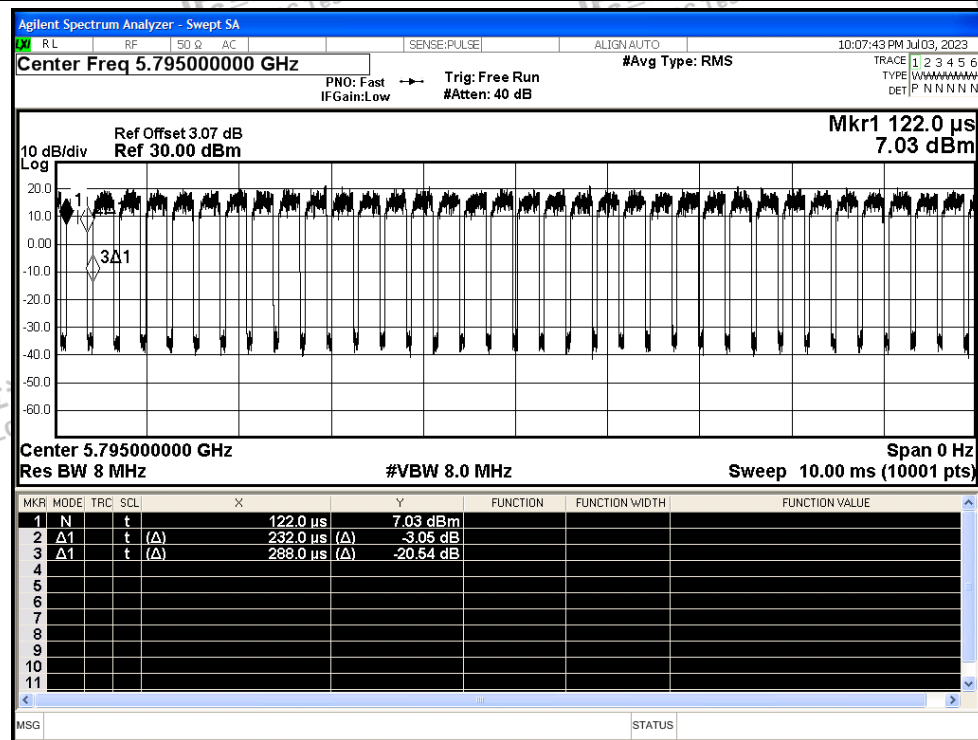

Duty Cycle NVNT ax80 5775MHz Ant1

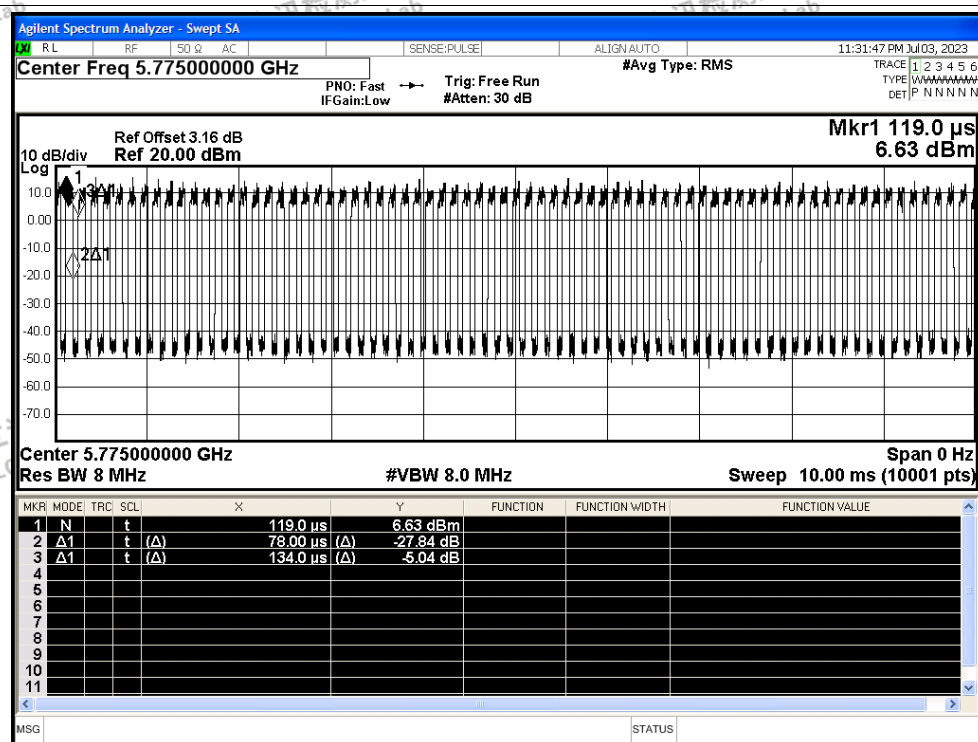

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant2	96.08	0.17	0.72
NVNT	a	5785	Ant2	96.08	0.17	0.72
NVNT	a	5825	Ant2	96.15	0.17	0.72
NVNT	n20	5745	Ant2	96.08	0.17	0.72
NVNT	n20	5785	Ant2	96.08	0.17	0.72
NVNT	n20	5825	Ant2	96.15	0.17	0.72
NVNT	n40	5755	Ant2	91.92	0.37	1.57
NVNT	n40	5795	Ant2	91.77	0.37	1.57
NVNT	ac20	5745	Ant2	95.85	0.18	0.76
NVNT	ac20	5785	Ant2	95.92	0.18	0.76
NVNT	ac20	5825	Ant2	95.85	0.18	0.76
NVNT	ac40	5755	Ant2	92.15	0.36	1.52
NVNT	ac40	5795	Ant2	92.15	0.36	1.52
NVNT	ac80	5775	Ant2	72.68	1.39	6.71
NVNT	ax20	5745	Ant2	94.79	0.23	0.98
NVNT	ax20	5785	Ant2	94.79	0.23	0.98
NVNT	ax20	5825	Ant2	94.79	0.23	0.98
NVNT	ax40	5755	Ant2	90.59	0.43	1.86
NVNT	ax40	5795	Ant2	90.59	0.43	1.86
NVNT	ax80	5775	Ant2	71.92	1.43	6.85




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5745MHz Ant2

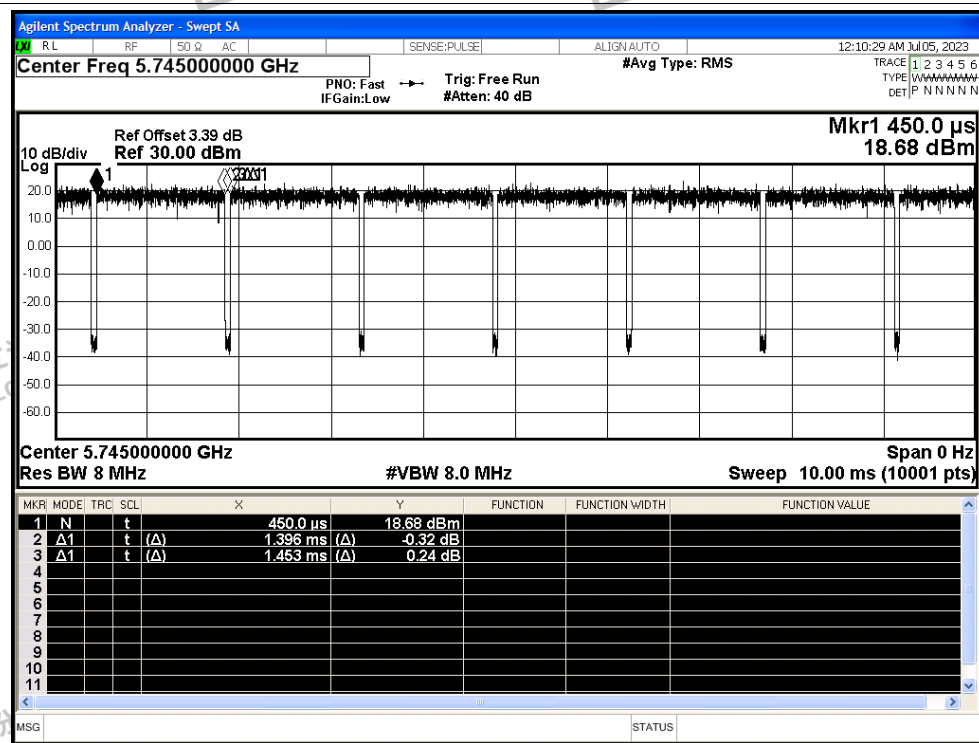


Duty Cycle NVNT a 5785MHz Ant2

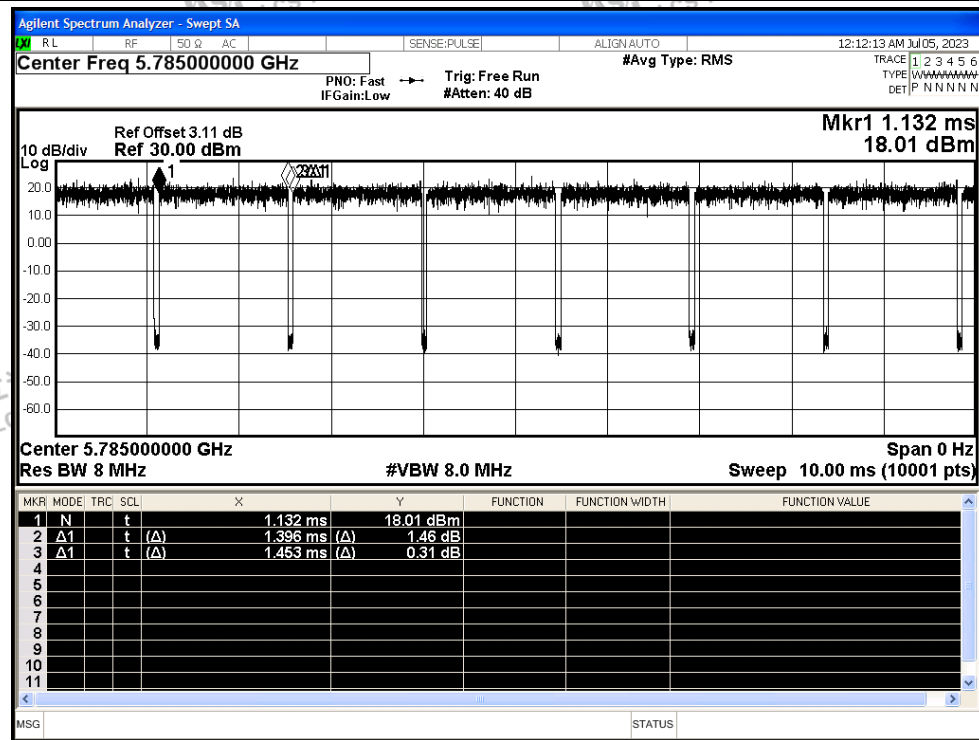




Duty Cycle NVNT a 5825MHz Ant2

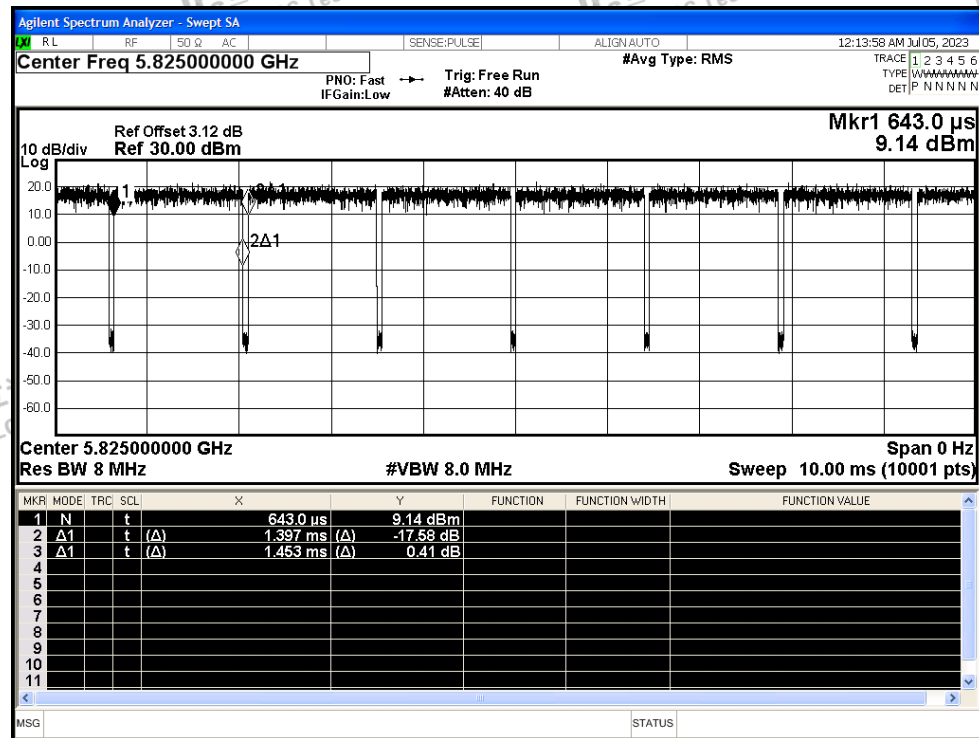


Duty Cycle NVNT n20 5745MHz Ant2

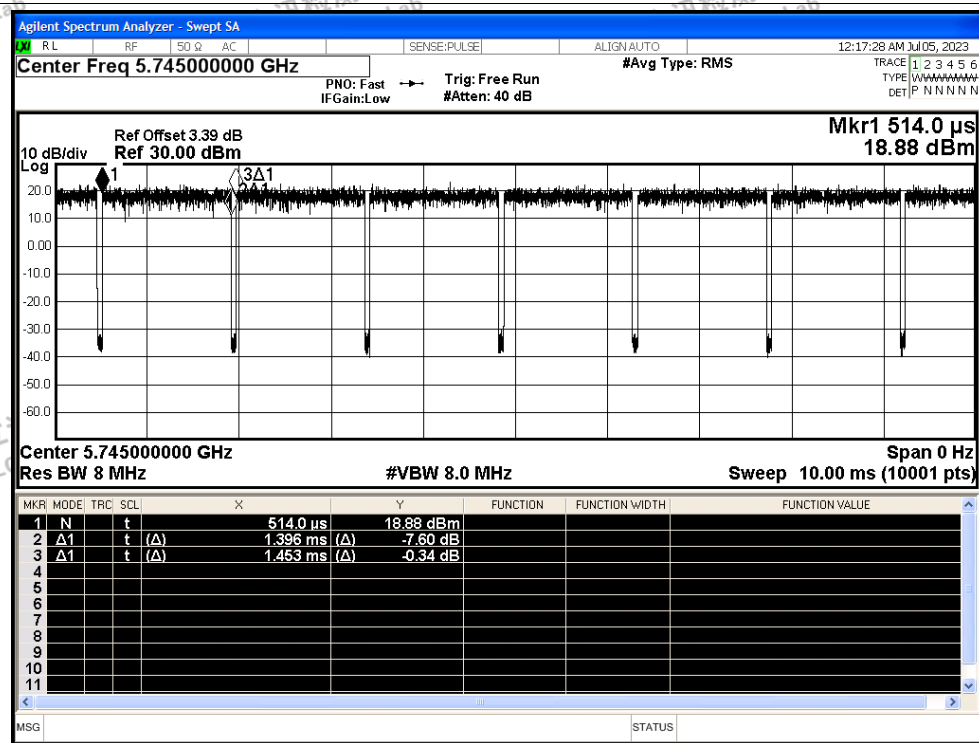




Duty Cycle NVNT n20 5785MHz Ant2

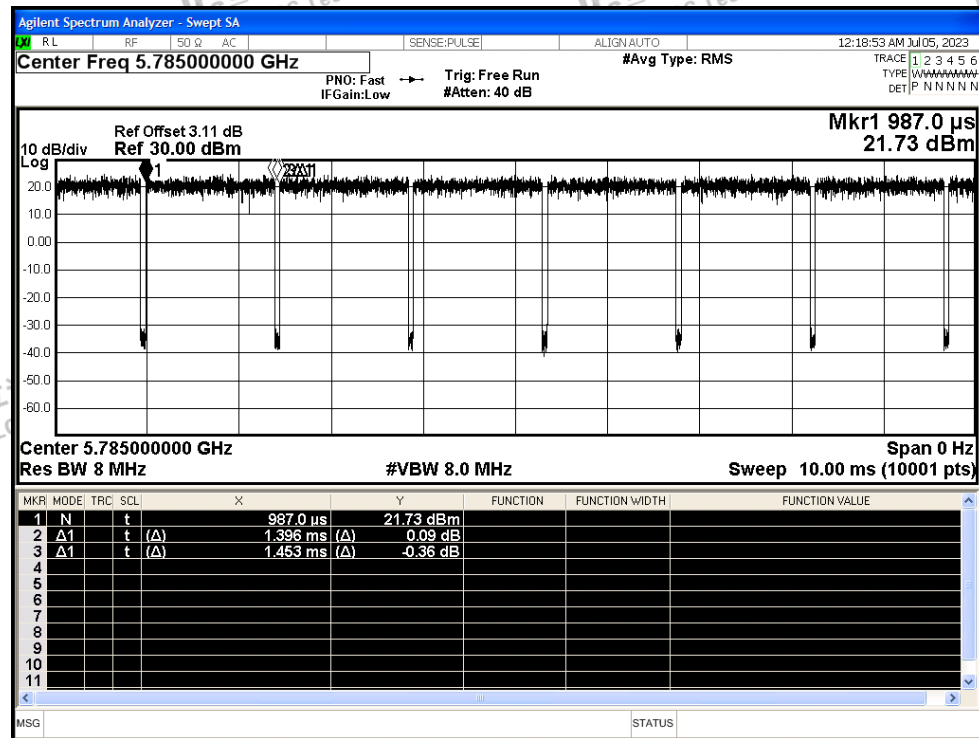


Duty Cycle NVNT n20 5825MHz Ant2

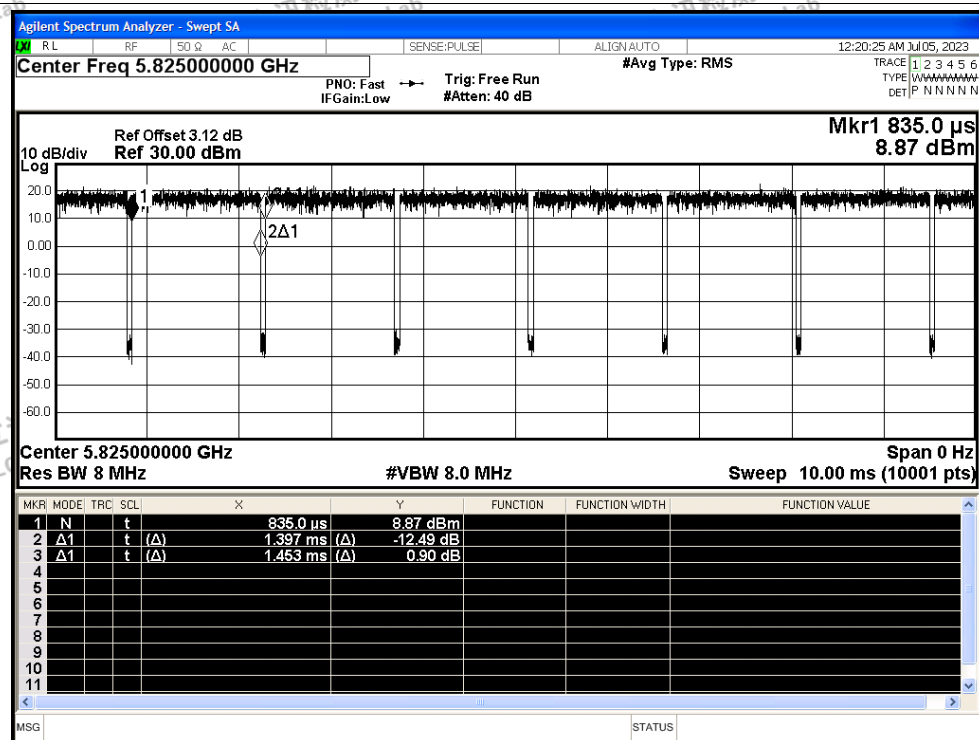




Duty Cycle NVNT n40 5755MHz Ant2

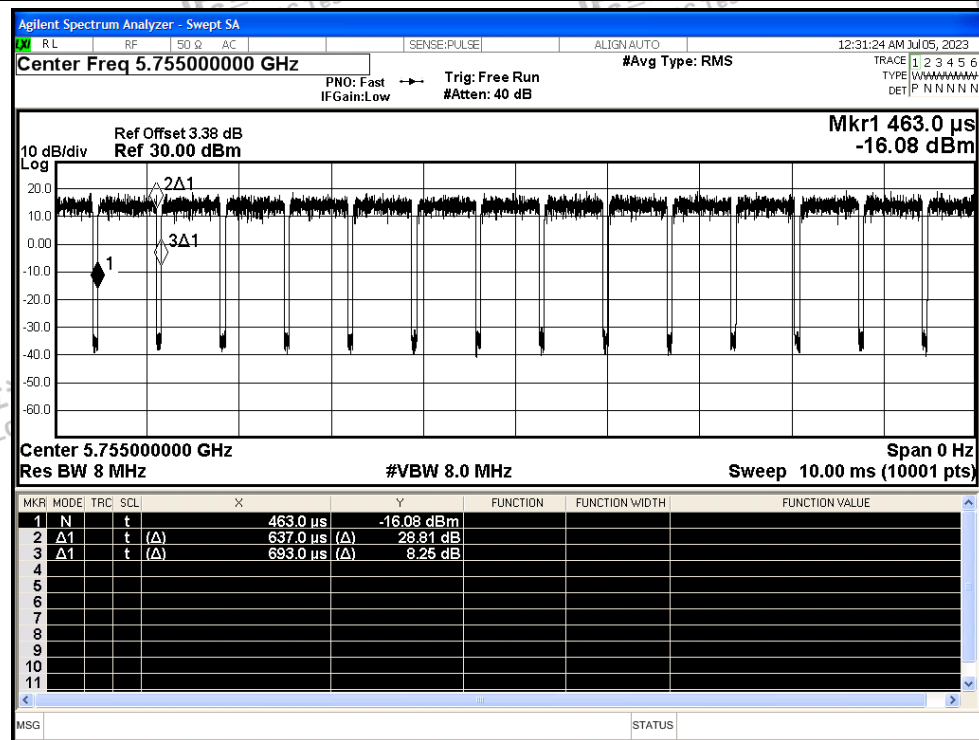


Duty Cycle NVNT n40 5795MHz Ant2

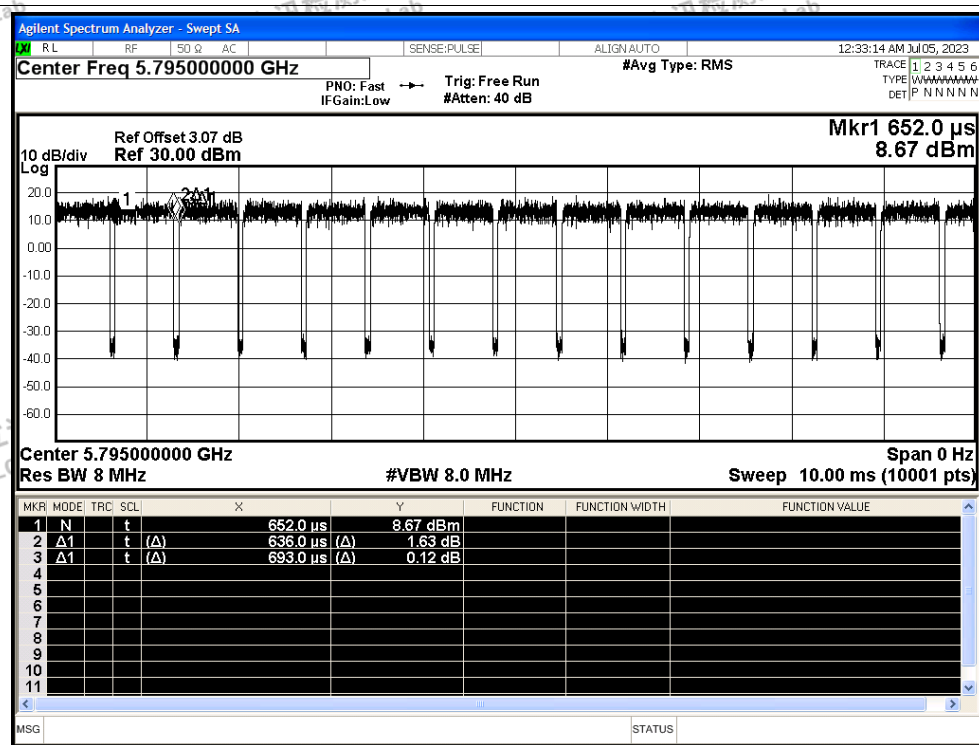




Duty Cycle NVNT ac20 5745MHz Ant2

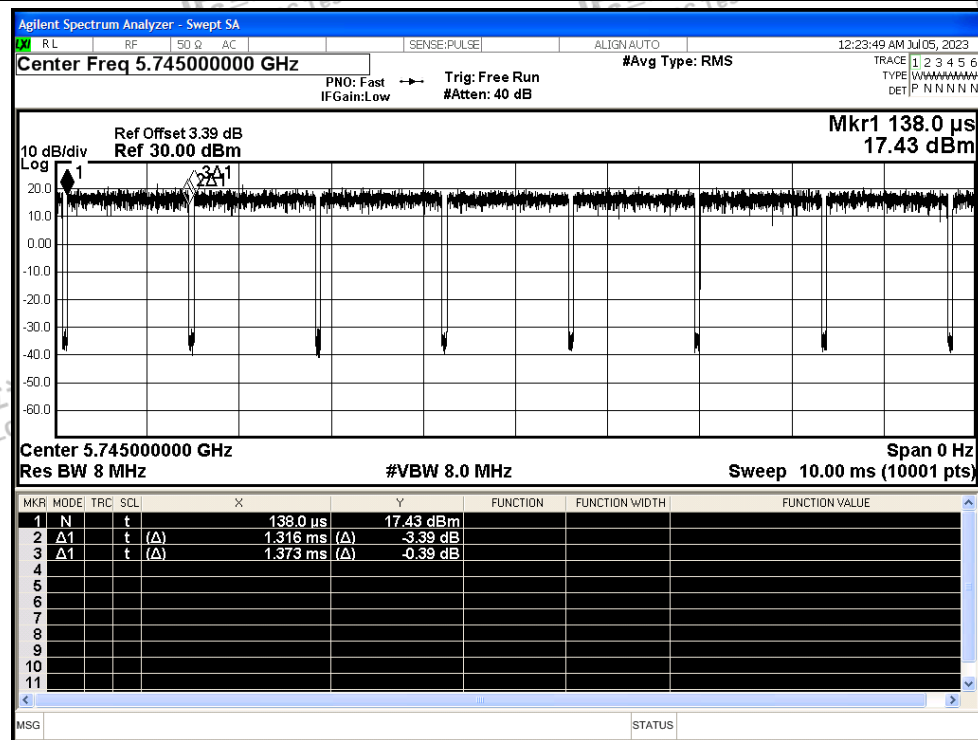


Duty Cycle NVNT ac20 5785MHz Ant2

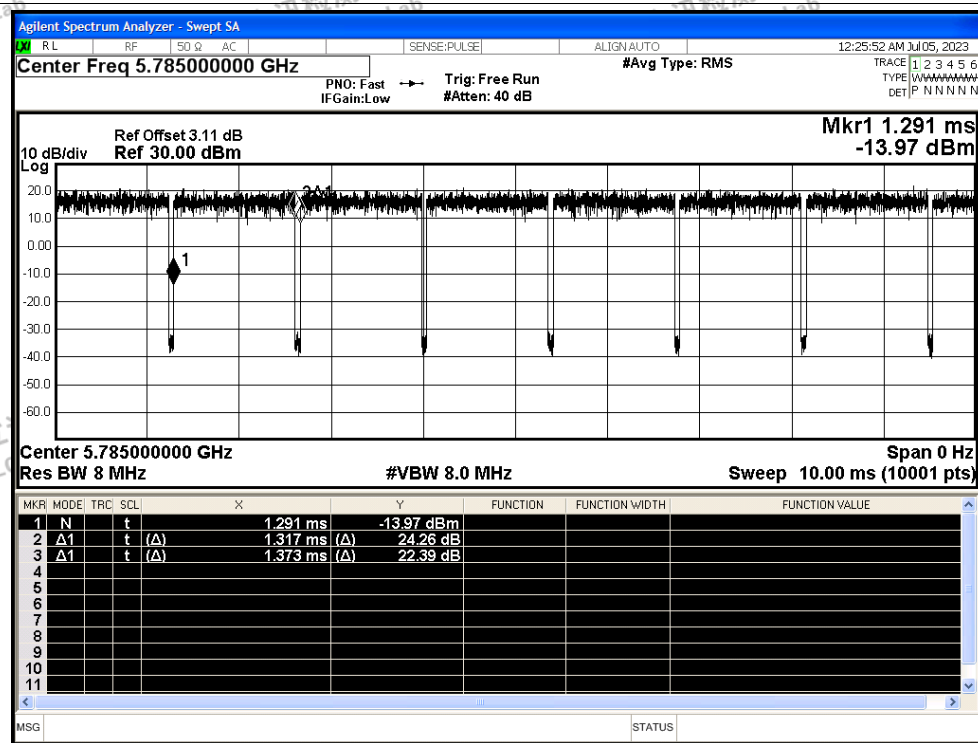




Duty Cycle NVNT ac20 5825MHz Ant2

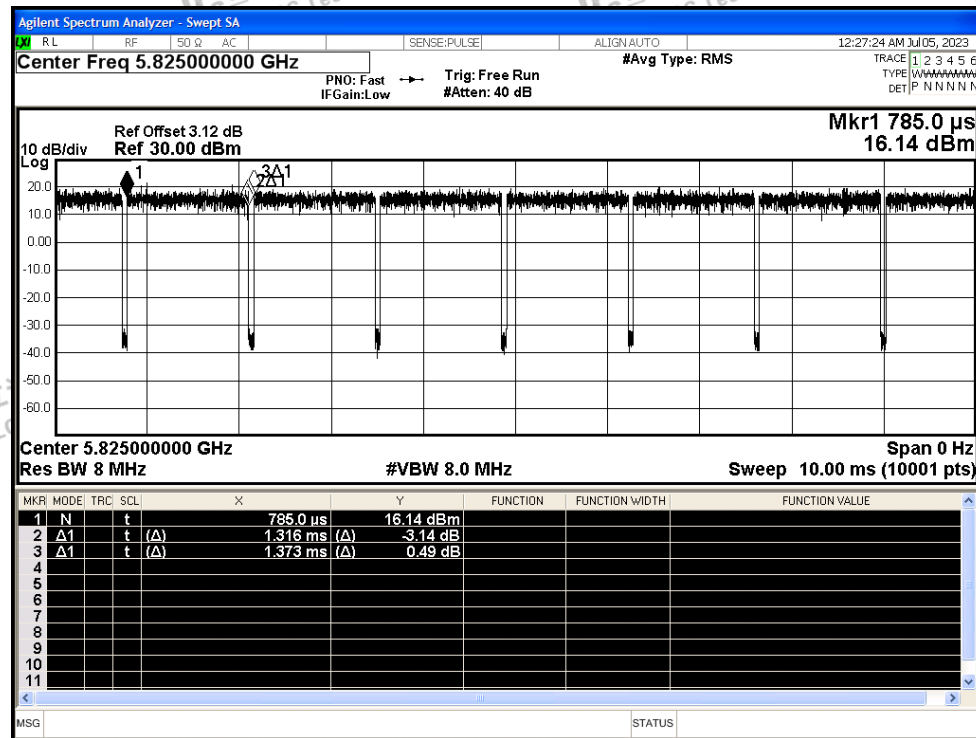


Duty Cycle NVNT ac40 5755MHz Ant2

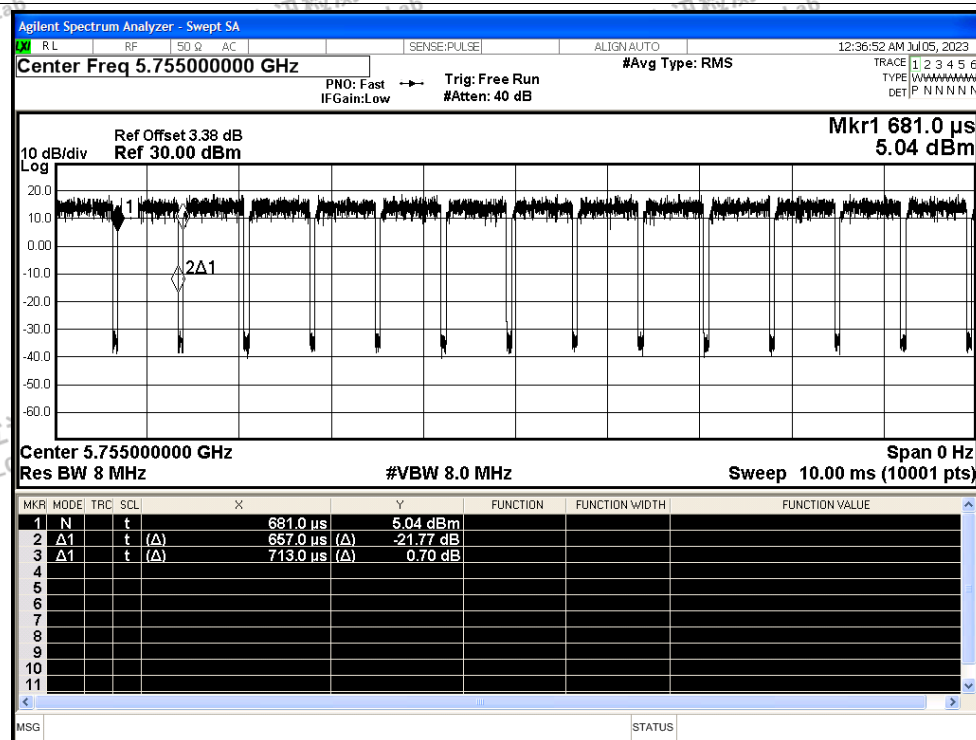




Duty Cycle NVNT ac40 5795MHz Ant2

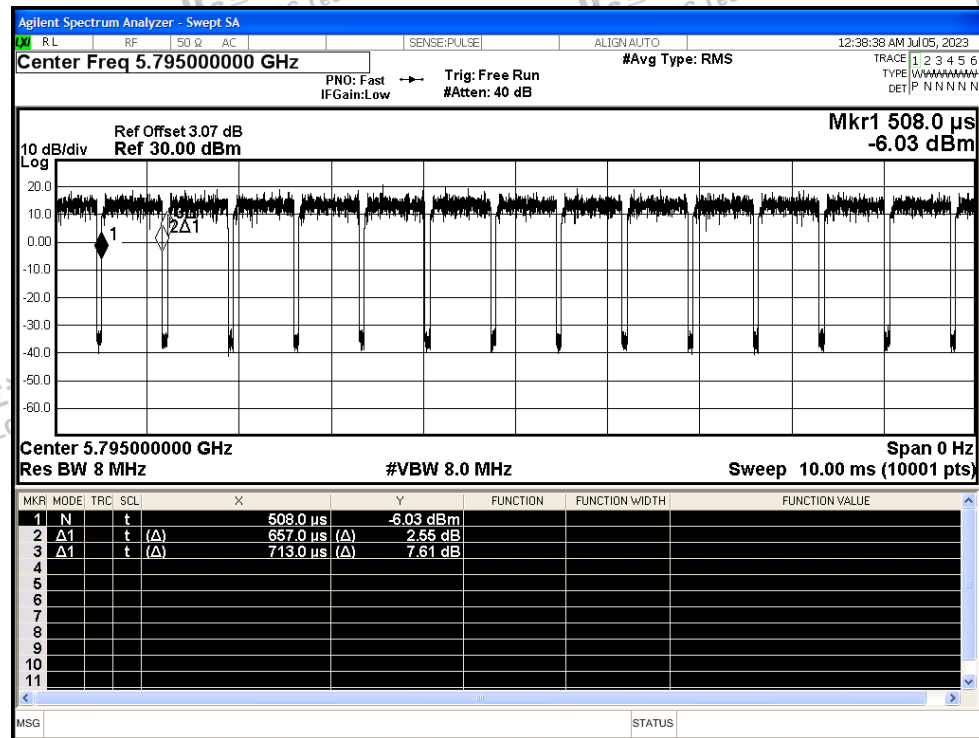


Duty Cycle NVNT ac80 5775MHz Ant2

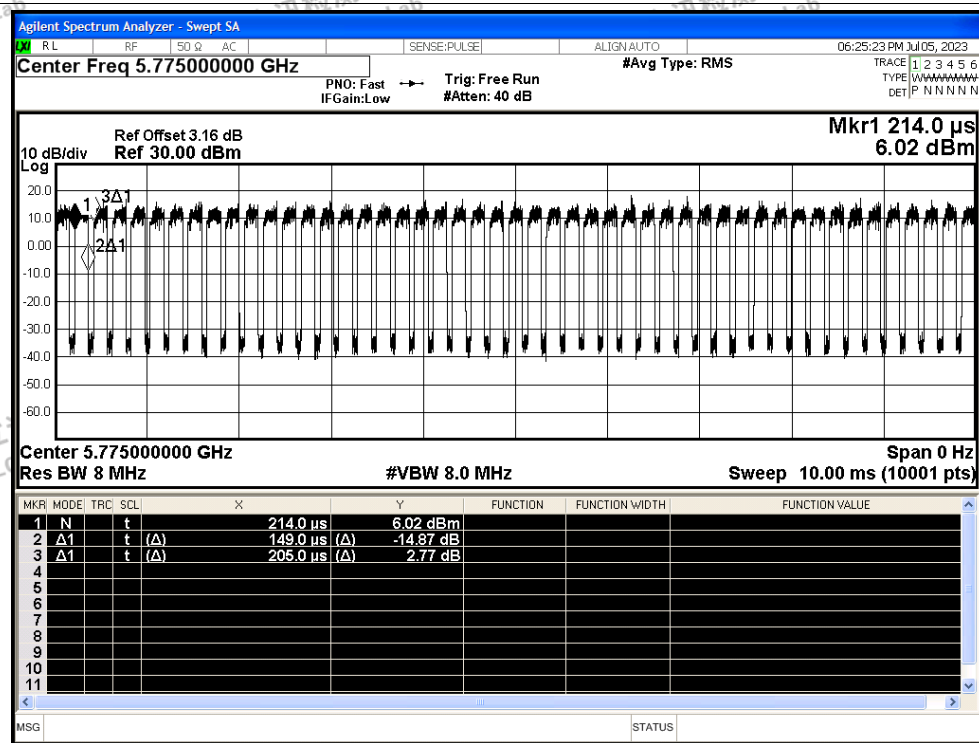




Duty Cycle NVNT ax20 5745MHz Ant2

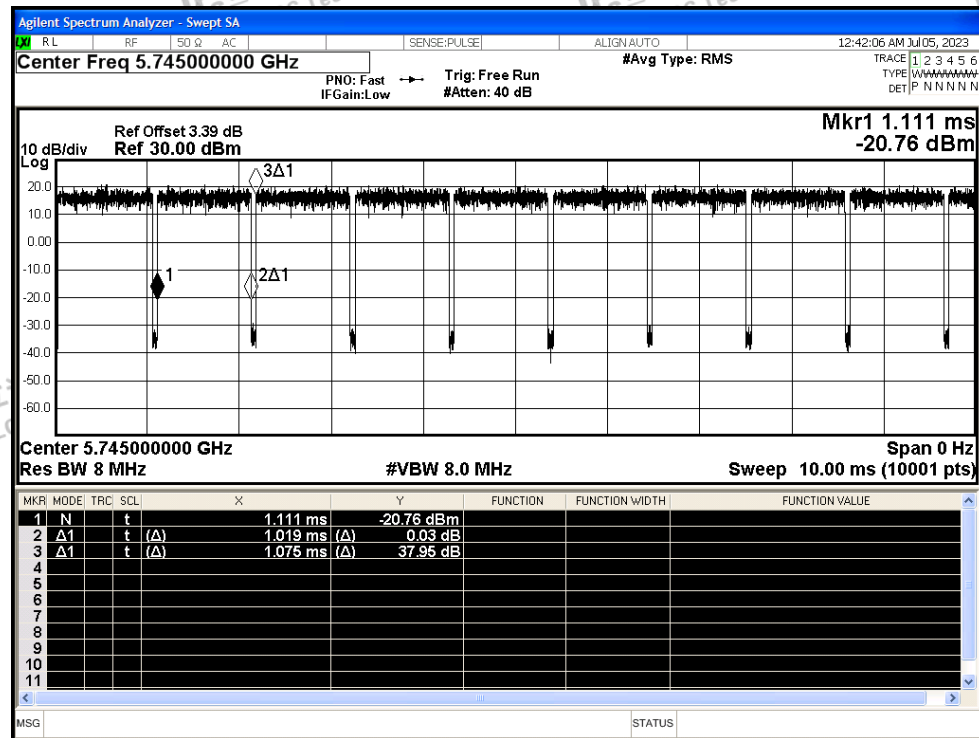


Duty Cycle NVNT ax20 5785MHz Ant2

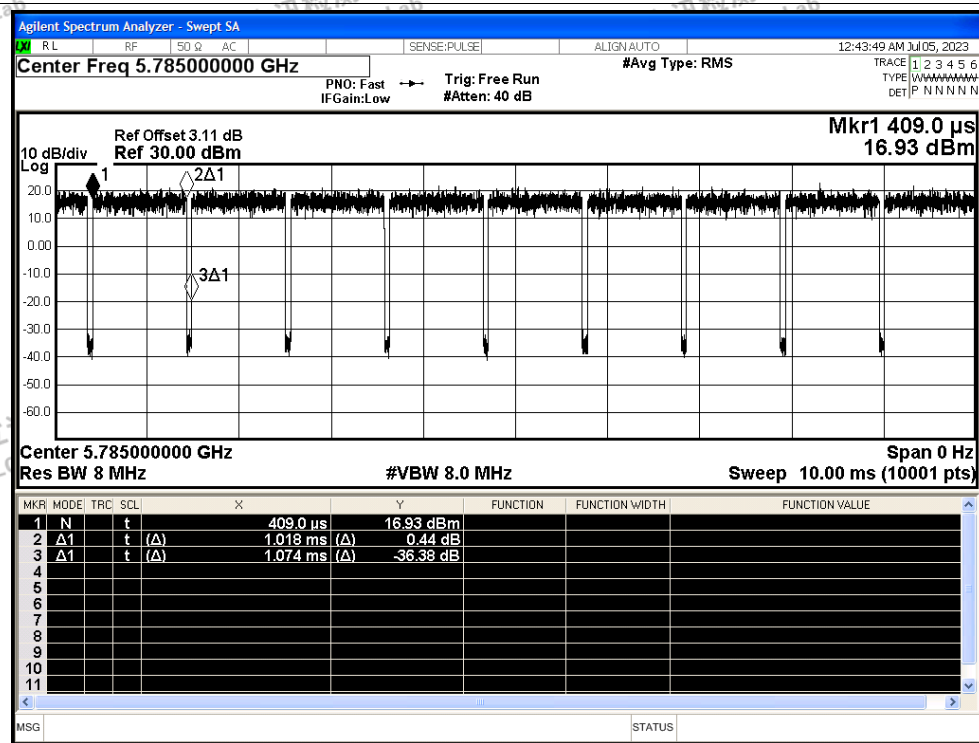


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Duty Cycle NVNT ax20 5825MHz Ant2

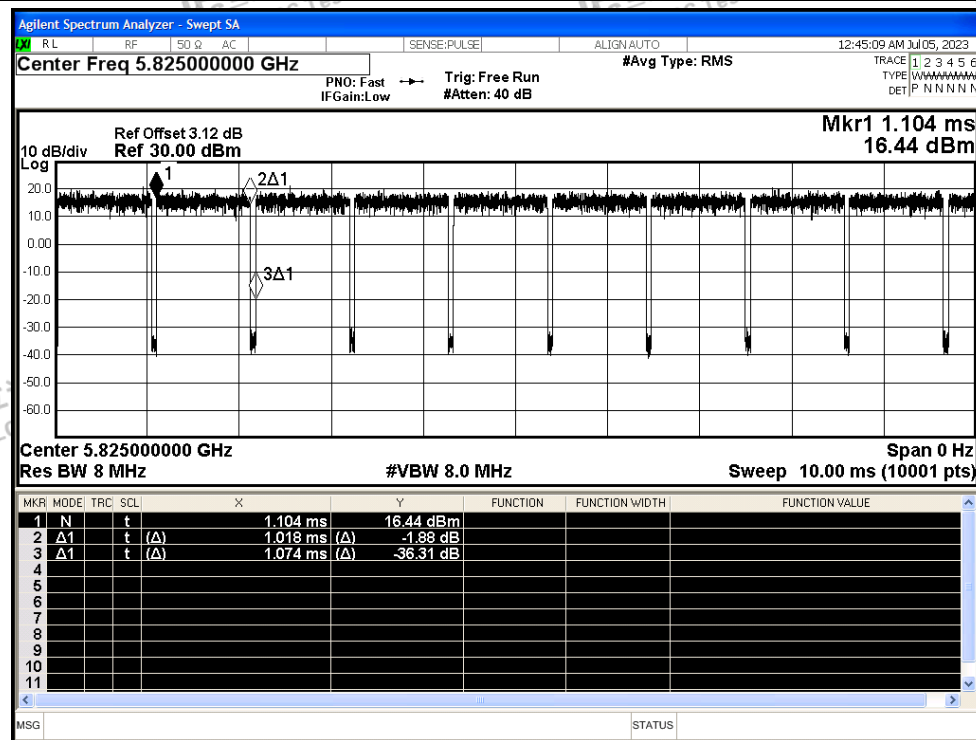


Duty Cycle NVNT ax40 5755MHz Ant2

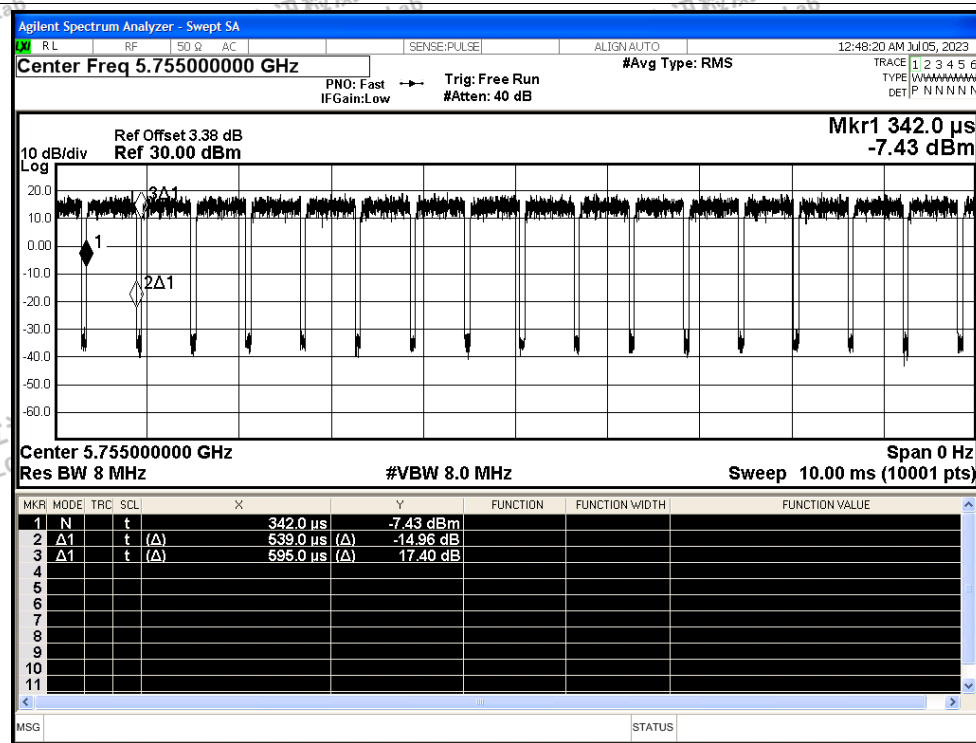



Duty Cycle NVNT ax40 5795MHz Ant2

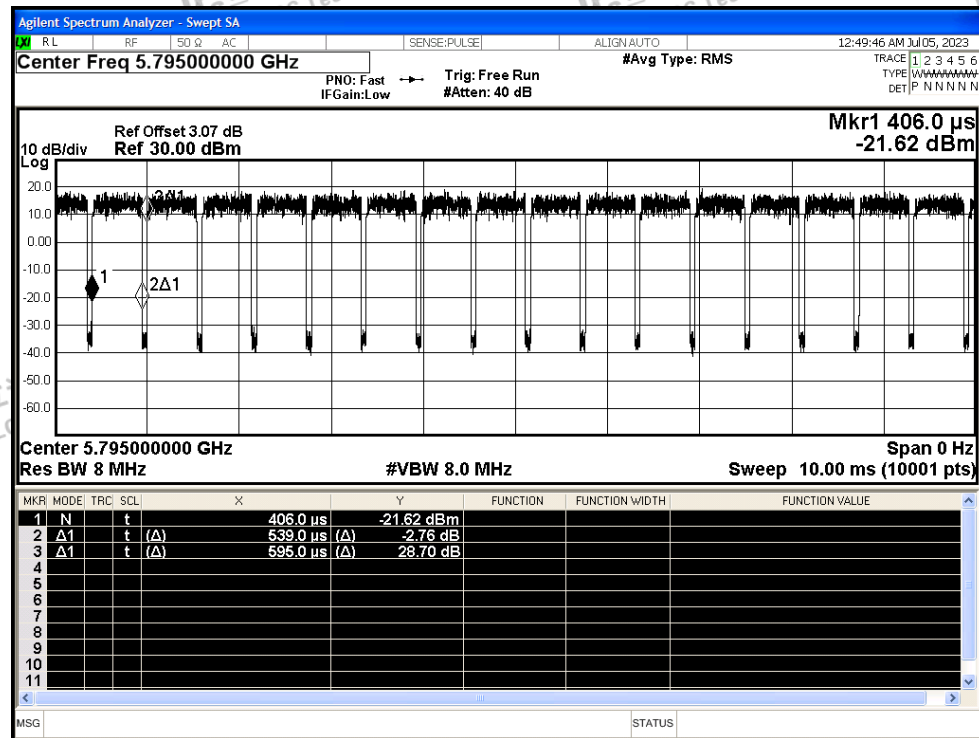

Duty Cycle NVNT ax80 5775MHz Ant2

