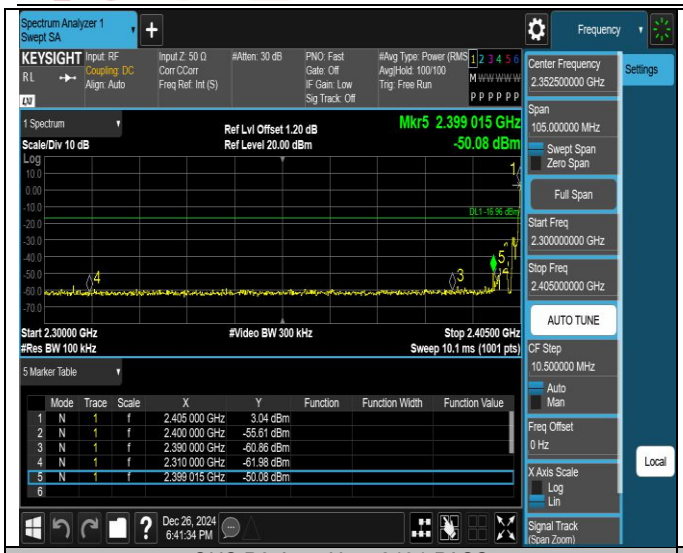

QHS P6-Ant5-Hop_2404-PASS

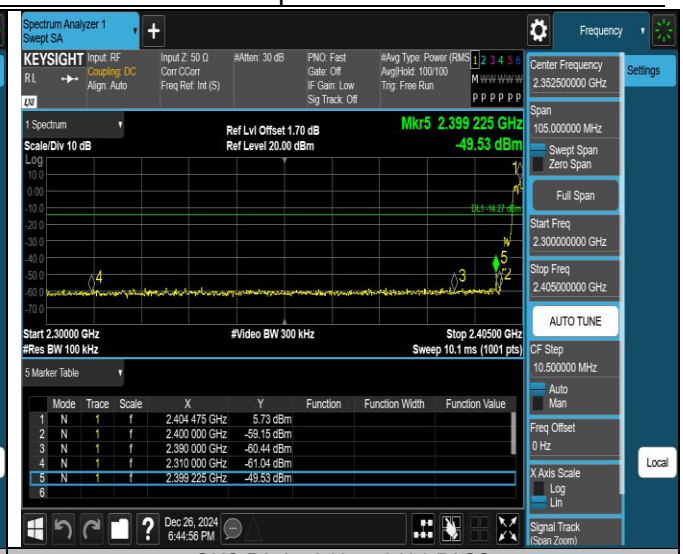

QHS P2-Ant8-Hop_2404-PASS

QHS P3-Ant8-Hop_2404-PASS

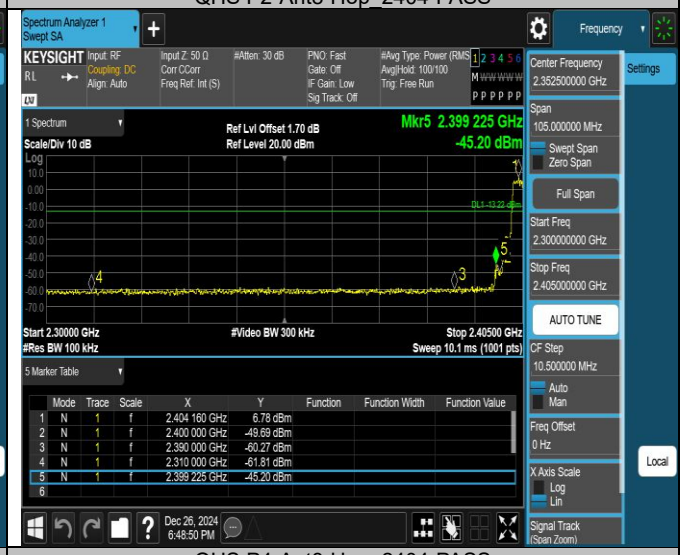

QHS P4-Ant8-Hop_2404-PASS

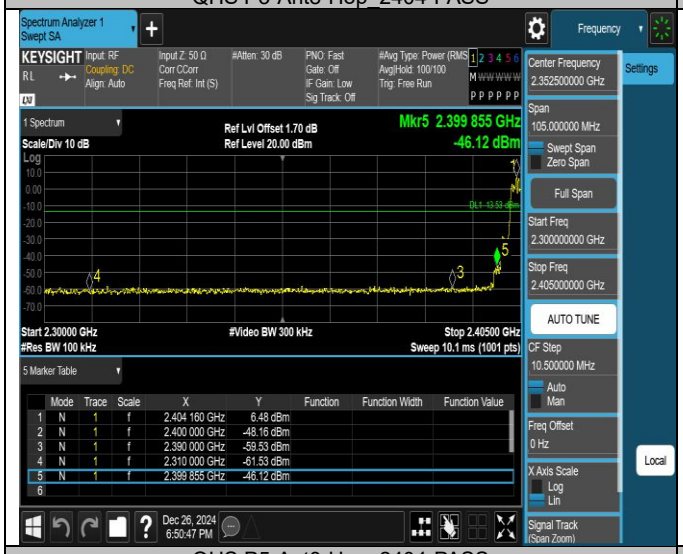

QHS P5-Ant8-Hop_2404-PASS

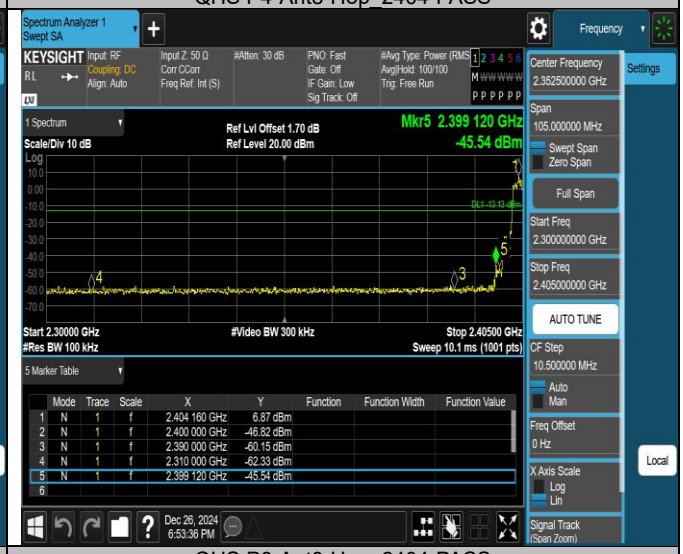

QHS P6-Ant8-Hop_2404-PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

QHS P2-Ant5-Hop_2478-PASS

QHS P3-Ant5-Hop_2478-PASS

QHS P4-Ant5-Hop_2478-PASS

QHS P5-Ant5-Hop_2478-PASS

QHS P6-Ant5-Hop_2478-PASS

QHS P2-Ant8-Hop_2478-PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

QHS P4-Ant8-Hop_2478-PASS

QHS P5-Ant8-Hop_2478-PASS

QHS P6-Ant8-Hop_2478-PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

Conducted Spurious Emission

Test Result

TestMode	Antenna	Frequency[MHz]	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
QHS P2	Ant5	2404	0~Reference	10.83	10.83	---	PASS
QHS P3	Ant5	2404	0~Reference	10.97	10.97	---	PASS
QHS P4	Ant5	2404	0~Reference	11.17	11.17	---	PASS
QHS P5	Ant5	2404	0~Reference	11.02	11.02	---	PASS
QHS P6	Ant5	2404	0~Reference	10.88	10.88	---	PASS
QHS P3	Ant8	2404	0~Reference	10.65	10.65	---	PASS
QHS P6	Ant8	2404	0~Reference	10.51	10.51	---	PASS
QHS P2	Ant8	2404	0~Reference	10.34	10.34	---	PASS
QHS P4	Ant8	2404	0~Reference	10.32	10.32	---	PASS
QHS P5	Ant8	2404	0~Reference	10.68	10.68	---	PASS
QHS P2	Ant5	2404	30~1000	10.83	-59.74	≤-9.17	PASS
QHS P3	Ant5	2404	30~1000	10.97	-59.84	≤-9.03	PASS
QHS P4	Ant5	2404	30~1000	11.17	-59.45	≤-8.83	PASS
QHS P5	Ant5	2404	30~1000	11.02	-60.11	≤-8.98	PASS
QHS P6	Ant5	2404	30~1000	10.88	-60.41	≤-9.12	PASS
QHS P3	Ant8	2404	30~1000	10.65	-58.73	≤-9.35	PASS
QHS P2	Ant8	2404	30~1000	10.34	-59.41	≤-9.66	PASS
QHS P6	Ant8	2404	30~1000	10.51	-59.29	≤-9.49	PASS
QHS P4	Ant8	2404	30~1000	10.32	-59.15	≤-9.68	PASS
QHS P5	Ant8	2404	30~1000	10.68	-59.27	≤-9.32	PASS
QHS P2	Ant5	2404	1000~26500	10.83	-50.81	≤-9.17	PASS
QHS P3	Ant5	2404	1000~26500	10.97	-50.58	≤-9.03	PASS
QHS P4	Ant5	2404	1000~26500	11.17	-51.21	≤-8.83	PASS
QHS P5	Ant5	2404	1000~26500	11.02	-51.41	≤-8.98	PASS
QHS P6	Ant5	2404	1000~26500	10.88	-50.95	≤-9.12	PASS
QHS P4	Ant8	2404	1000~26500	10.32	-50.64	≤-9.68	PASS
QHS P6	Ant8	2404	1000~26500	10.51	-49.11	≤-9.49	PASS
QHS P2	Ant8	2404	1000~26500	10.34	-50.01	≤-9.66	PASS
QHS P3	Ant8	2404	1000~26500	10.65	-50.29	≤-9.35	PASS
QHS P5	Ant8	2404	1000~26500	10.68	-49.56	≤-9.32	PASS
QHS P2	Ant5	2440	0~Reference	11.70	11.70	---	PASS
QHS P3	Ant5	2440	0~Reference	10.71	10.71	---	PASS
QHS P4	Ant5	2440	0~Reference	8.57	8.57	---	PASS
QHS P5	Ant5	2440	0~Reference	11.75	11.75	---	PASS
QHS P6	Ant5	2440	0~Reference	10.56	10.56	---	PASS
QHS P6	Ant8	2440	0~Reference	9.25	9.25	---	PASS
QHS P2	Ant8	2440	0~Reference	11.36	11.36	---	PASS
QHS P3	Ant8	2440	0~Reference	10.43	10.43	---	PASS
QHS P4	Ant8	2440	0~Reference	11.58	11.58	---	PASS
QHS P5	Ant8	2440	0~Reference	10.28	10.28	---	PASS
QHS P2	Ant5	2440	30~1000	11.70	-59.67	≤-8.3	PASS
QHS P3	Ant5	2440	30~1000	10.71	-59.85	≤-9.29	PASS
QHS P4	Ant5	2440	30~1000	8.57	-59.92	≤-11.43	PASS
QHS P5	Ant5	2440	30~1000	11.75	-59.43	≤-8.25	PASS
QHS P6	Ant5	2440	30~1000	10.56	-59.84	≤-9.44	PASS
QHS P5	Ant8	2440	30~1000	10.28	-59.47	≤-9.72	PASS
QHS P6	Ant8	2440	30~1000	9.25	-58.93	≤-10.75	PASS
QHS P2	Ant8	2440	30~1000	11.36	-59.36	≤-8.64	PASS
QHS P3	Ant8	2440	30~1000	10.43	-58.73	≤-9.57	PASS
QHS P4	Ant8	2440	30~1000	11.58	-58.71	≤-8.42	PASS
QHS P2	Ant5	2440	1000~26500	11.70	-50.46	≤-8.3	PASS
QHS P3	Ant5	2440	1000~26500	10.71	-50.74	≤-9.29	PASS
QHS P4	Ant5	2440	1000~26500	8.57	-50.47	≤-11.43	PASS
QHS P5	Ant5	2440	1000~26500	11.75	-50.26	≤-8.25	PASS
QHS P6	Ant5	2440	1000~26500	10.56	-50.62	≤-9.44	PASS
QHS P5	Ant8	2440	1000~26500	10.28	-49.57	≤-9.72	PASS
QHS P6	Ant8	2440	1000~26500	9.25	-49.99	≤-10.75	PASS
QHS P2	Ant8	2440	1000~26500	11.36	-50.23	≤-8.64	PASS
QHS P3	Ant8	2440	1000~26500	10.43	-50.11	≤-9.57	PASS
QHS P4	Ant8	2440	1000~26500	11.58	-49.45	≤-8.42	PASS
QHS P2	Ant5	2478	0~Reference	10.67	10.67	---	PASS
QHS P3	Ant5	2478	0~Reference	9.17	9.17	---	PASS
QHS P4	Ant5	2478	0~Reference	10.22	10.22	---	PASS
QHS P5	Ant5	2478	0~Reference	11.41	11.41	---	PASS
QHS P6	Ant5	2478	0~Reference	10.43	10.43	---	PASS
QHS P5	Ant8	2478	0~Reference	11.28	11.28	---	PASS
QHS P6	Ant8	2478	0~Reference	10.54	10.54	---	PASS
QHS P2	Ant8	2478	0~Reference	11.16	11.16	---	PASS
QHS P3	Ant8	2478	0~Reference	11.32	11.32	---	PASS
QHS P4	Ant8	2478	0~Reference	11.30	11.30	---	PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

QHS P2	Ant5	2478	30~1000	10.67	-60.12	≤-9.33	PASS
QHS P3	Ant5	2478	30~1000	9.17	-59.31	≤-10.83	PASS
QHS P4	Ant5	2478	30~1000	10.22	-58.88	≤-9.78	PASS
QHS P5	Ant5	2478	30~1000	11.41	-59.61	≤-8.59	PASS
QHS P6	Ant5	2478	30~1000	10.43	-59.4	≤-9.57	PASS
QHS P5	Ant8	2478	30~1000	11.28	-58.95	≤-8.72	PASS
QHS P6	Ant8	2478	30~1000	10.54	-58.22	≤-9.46	PASS
QHS P2	Ant8	2478	30~1000	11.16	-58.2	≤-8.84	PASS
QHS P3	Ant8	2478	30~1000	11.32	-59.25	≤-8.68	PASS
QHS P4	Ant8	2478	30~1000	11.30	-58.77	≤-8.7	PASS
QHS P2	Ant5	2478	1000~26500	10.67	-50.2	≤-9.33	PASS
QHS P3	Ant5	2478	1000~26500	9.17	-50.55	≤-10.83	PASS
QHS P4	Ant5	2478	1000~26500	10.22	-50.54	≤-9.78	PASS
QHS P5	Ant5	2478	1000~26500	11.41	-51.02	≤-8.59	PASS
QHS P6	Ant5	2478	1000~26500	10.43	-50.22	≤-9.57	PASS
QHS P5	Ant8	2478	1000~26500	11.28	-49.97	≤-8.72	PASS
QHS P6	Ant8	2478	1000~26500	10.54	-50.45	≤-9.46	PASS
QHS P2	Ant8	2478	1000~26500	11.16	-50.23	≤-8.84	PASS
QHS P3	Ant8	2478	1000~26500	11.32	-48.95	≤-8.68	PASS
QHS P4	Ant8	2478	1000~26500	11.30	-49.6	≤-8.7	PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

Test Graphs

QHS P2-Ant5-2404-0~Reference-PASS

QHS P3-Ant5-2404-0~Reference-PASS

QHS P4-Ant5-2404-0~Reference-PASS

QHS P5-Ant5-2404-0~Reference-PASS

QHS P6-Ant5-2404-0~Reference-PASS

QHS P3-Ant8-2404-0~Reference-PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

QHS P6-Ant8-2404-0~Reference-PASS

QHS P2-Ant8-2404-0~Reference-PASS

QHS P4-Ant8-2404-0~Reference-PASS

QHS P5-Ant8-2404-0~Reference-PASS

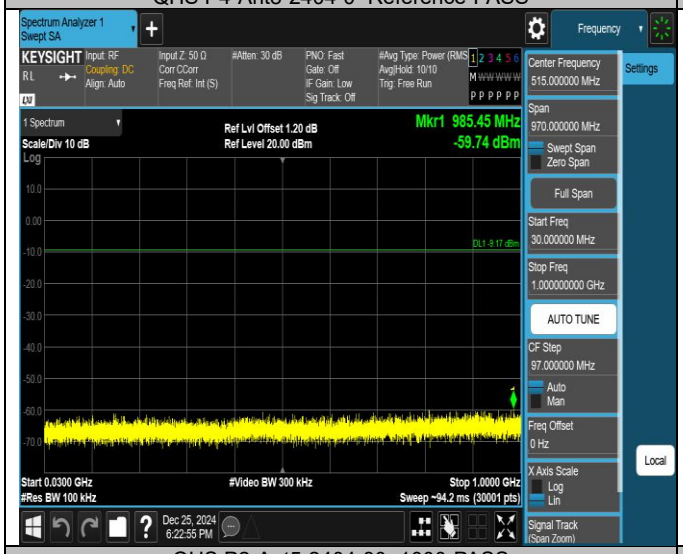

QHS P2-Ant5-2404-30~1000-PASS

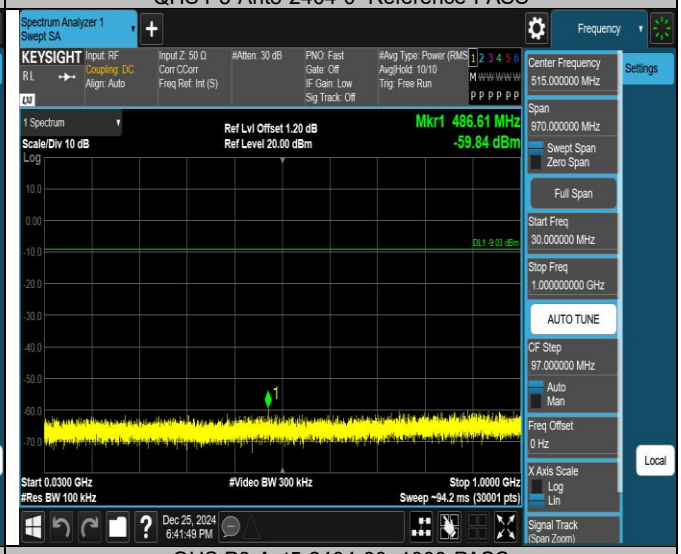

QHS P3-Ant5-2404-30~1000-PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

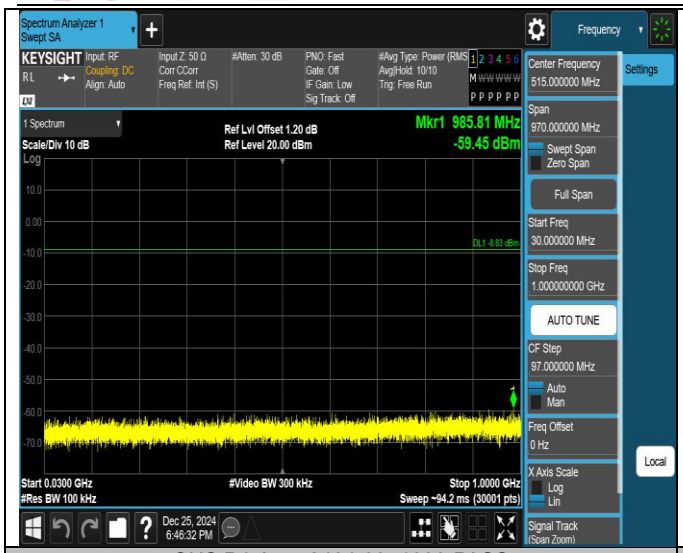

QHS P4-Ant5-2404-30~1000-PASS

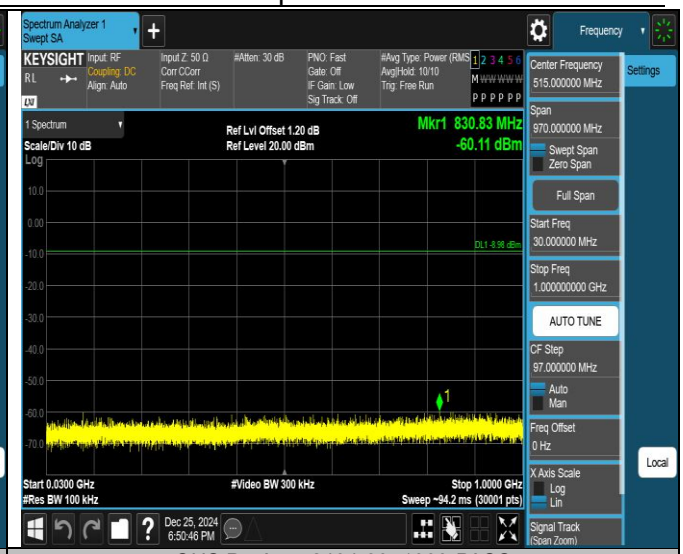

QHS P5-Ant5-2404-30~1000-PASS

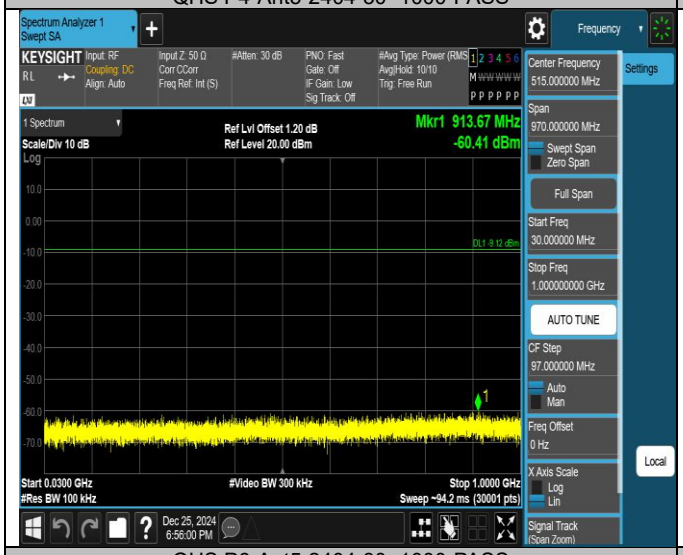

QHS P6-Ant5-2404-30~1000-PASS

QHS P3-Ant8-2404-30~1000-PASS

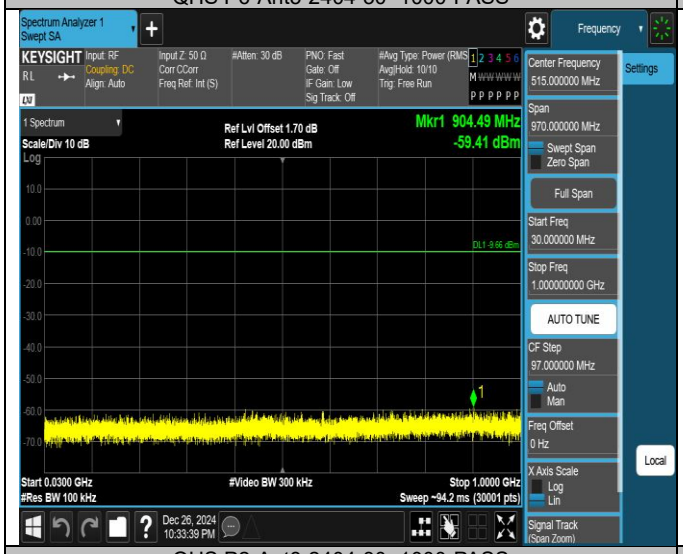

QHS P2-Ant8-2404-30~1000-PASS

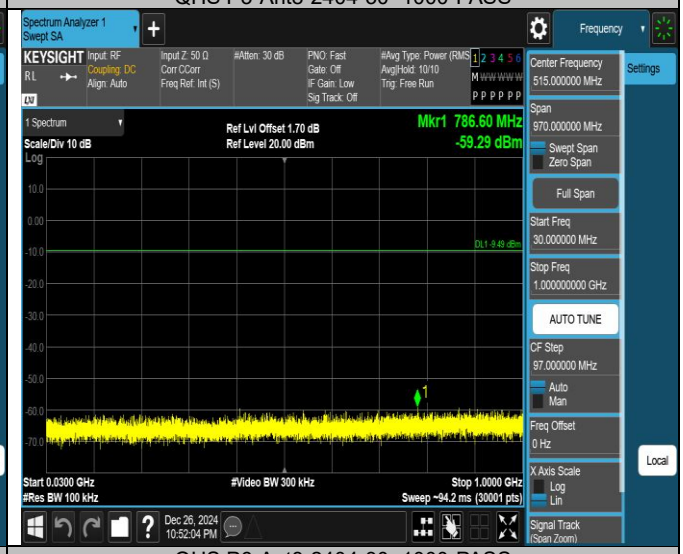

QHS P6-Ant8-2404-30~1000-PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

QHS P4-Ant8-2404-30~1000-PASS

QHS P5-Ant8-2404-30~1000-PASS

QHS P2-Ant5-2404-1000~26500-PASS

QHS P3-Ant5-2404-1000~26500-PASS

QHS P4-Ant5-2404-1000~26500-PASS

QHS P5-Ant5-2404-1000~26500-PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

QHS P6-Ant5-2404-1000~26500-PASS

QHS P4-Ant8-2404-1000~26500-PASS

QHS P6-Ant8-2404-1000~26500-PASS

QHS P2-Ant8-2404-1000~26500-PASS

QHS P3-Ant8-2404-1000~26500-PASS

QHS P5-Ant8-2404-1000~26500-PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

QHS P2-Ant5-2440-0~Reference-PASS

QHS P3-Ant5-2440-0~Reference-PASS

QHS P4-Ant5-2440-0~Reference-PASS

QHS P5-Ant5-2440-0~Reference-PASS

QHS P6-Ant5-2440-0~Reference-PASS

QHS P6-Ant8-2440-0~Reference-PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

QHS P2-Ant8-2440-0~Reference-PASS

QHS P3-Ant8-2440-0~Reference-PASS

QHS P4-Ant8-2440-0~Reference-PASS

QHS P5-Ant8-2440-0~Reference-PASS

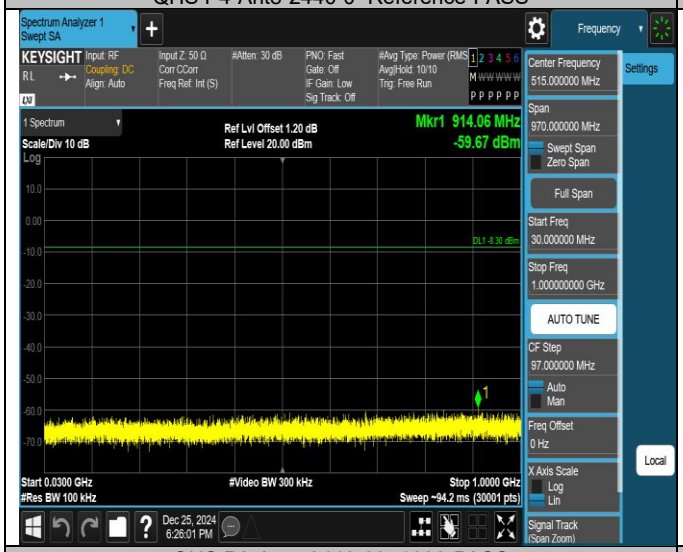

QHS P2-Ant5-2440-30~1000-PASS

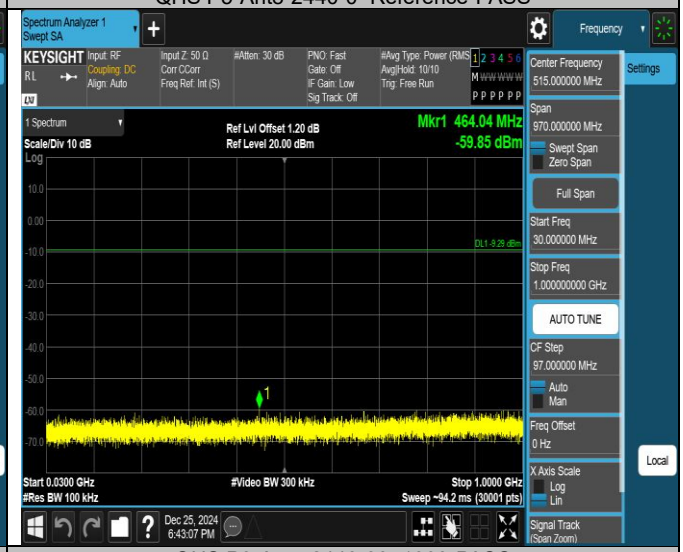

QHS P3-Ant5-2440-30~1000-PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.

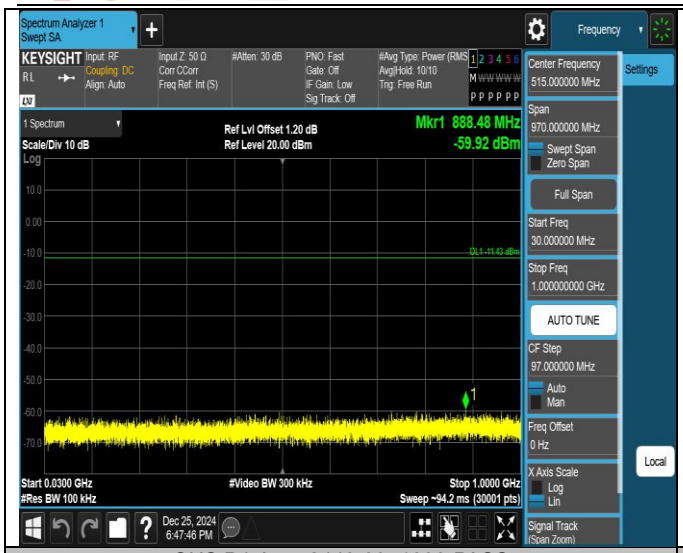

QHS P4-Ant5-2440-30~1000-PASS

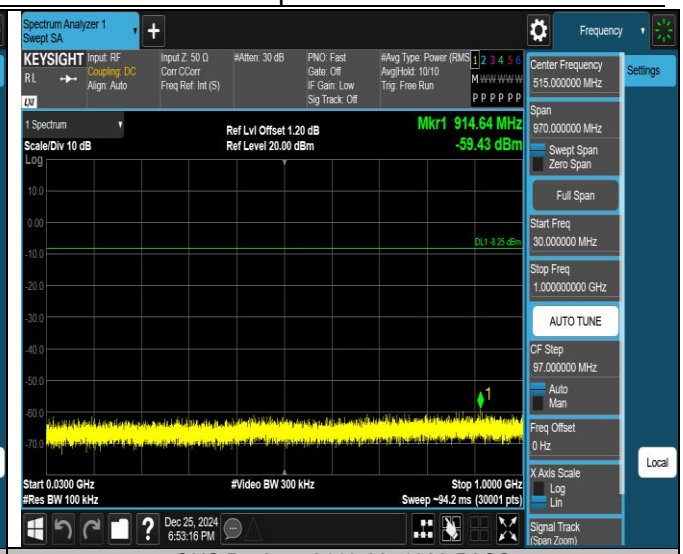

QHS P5-Ant5-2440-30~1000-PASS

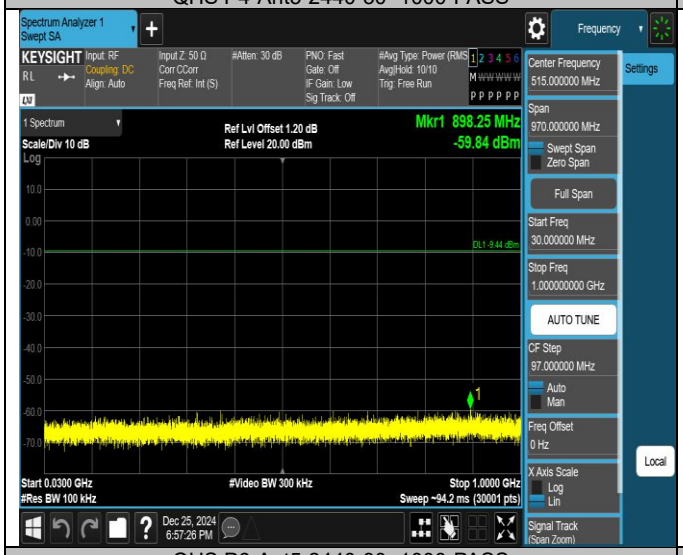

QHS P6-Ant5-2440-30~1000-PASS

QHS P5-Ant8-2440-30~1000-PASS

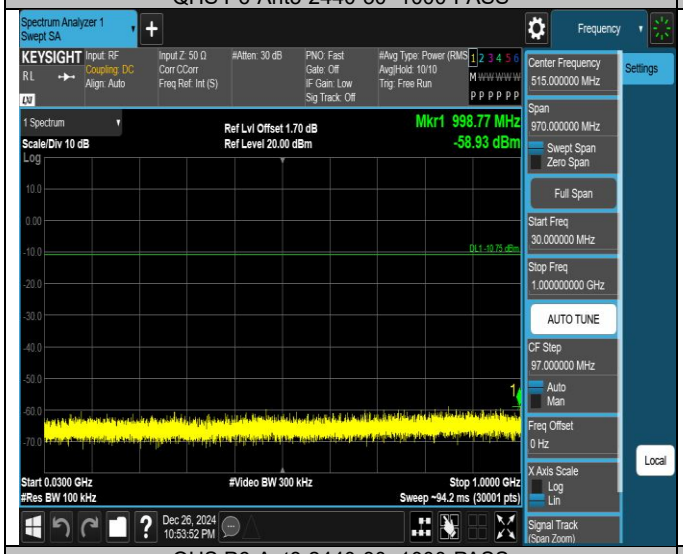

QHS P6-Ant8-2440-30~1000-PASS

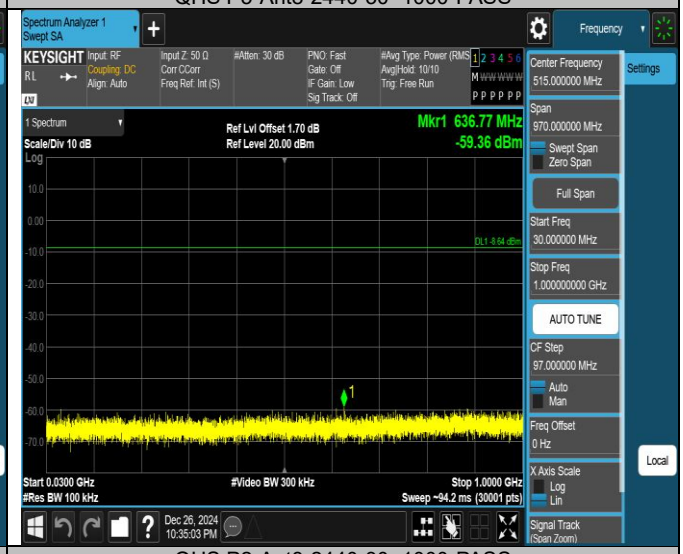

QHS P2-Ant8-2440-30~1000-PASS

All rights reserved. Unless otherwise specified, no part of this report may be reproduced or utilized in any part, form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from TOWE.