




American Telecommunications Certification Body Inc.
6731 Whittier Ave, McLean, VA 22101

May 10, 2005

RE: FCC ID: Q7Z-MA720R1_ATCB002413
Attention: Vincent Su

I have a few comments on this Application. Please note that further comments may arise in response to answers provided to the questions below.

1. The manual on the above device does not appear to contain the required non-modification statement per 15.21 nor the users info statement per 15.105.
2. Please note that the test setup photos appear to show the device on the table and not connected to the USB port. As this device derives power from the USB port, please show the device being tested while installed in the USB port. IF the device is installed in the USB port, please point to the device in the photos or take a close up photo of the device.
3. Please note that the 20dB band width plots on page 19 do not look like a typical Bluetooth device and there is no resemblance to the wave shape shown in the separation plots (i.e. no 26+dB spike at the center frequency). Please note that the 20dB bandwidth of a BT device should be approximately 650kHz to 850kHz as follows:

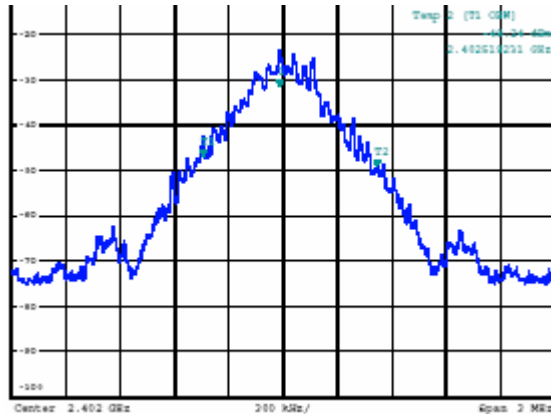

The data in the plots in the report provided show an unusually high spike (26+dB) at the center frequency. This indicates the device is not functioning properly or an error in measurement setup has occurred. Please explain. Please provide 20dB bandwidth plots that are in line with that expected of a BT device.

Dennis Ward

Dennis Ward
<mailto:dward@AmericanTCB.com>

The items indicated above must be submitted before processing can continue on the above referenced application. Failure to provide the requested information may result in application termination. Correspondence should be considered part of the permanent submission and may be viewed from the Internet after a Grant of Equipment Authorization is issued.

Please do not respond to this correspondence using the email reply button. In order for your response to be processed expeditiously, you must submit your documents through the AmericanTCB.com website. Also, please note that partial responses increase processing time and should not be submitted.

Any questions about the content of this correspondence should be directed to the sender.