
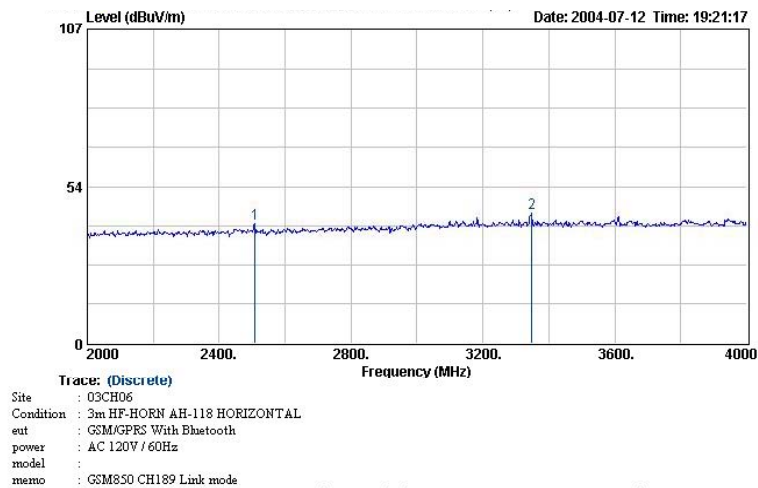


FCC TEST REPORT

Report No. : F462917

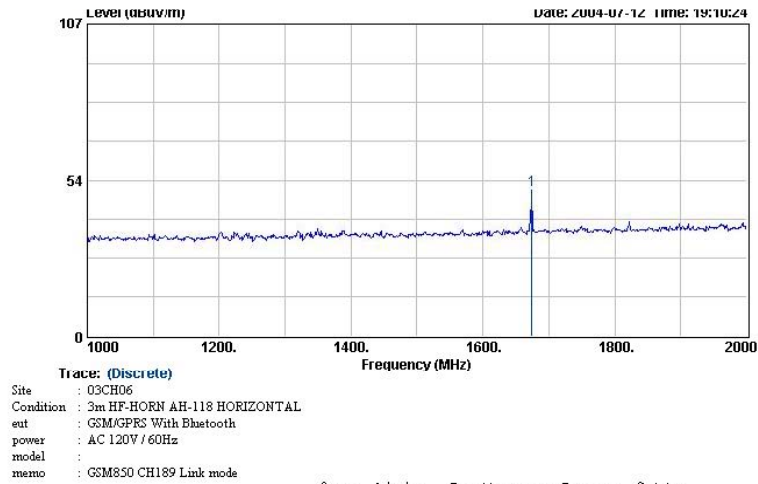

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255

FCC ID

QDJ-0406CHA11

Page No.


51 of 82

Issued Date

July 17, 2004

FCC TEST REPORT

Report No. : F462917

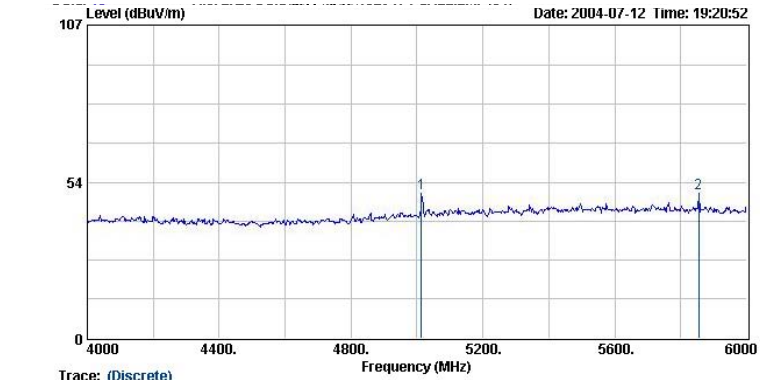

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255

FCC ID

QDJ-0406CHA11

Page No.

52 of 82



Issued Date

July 17, 2004

FCC TEST REPORT

Report No. : F462917

GSM 850, Vertical Polarization

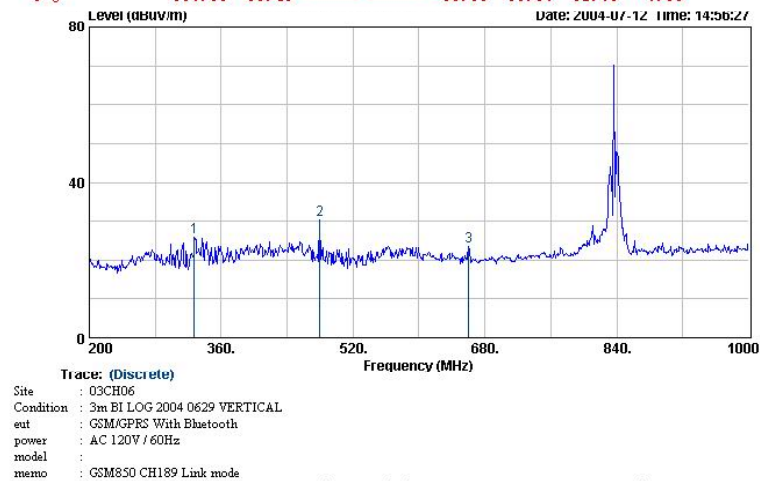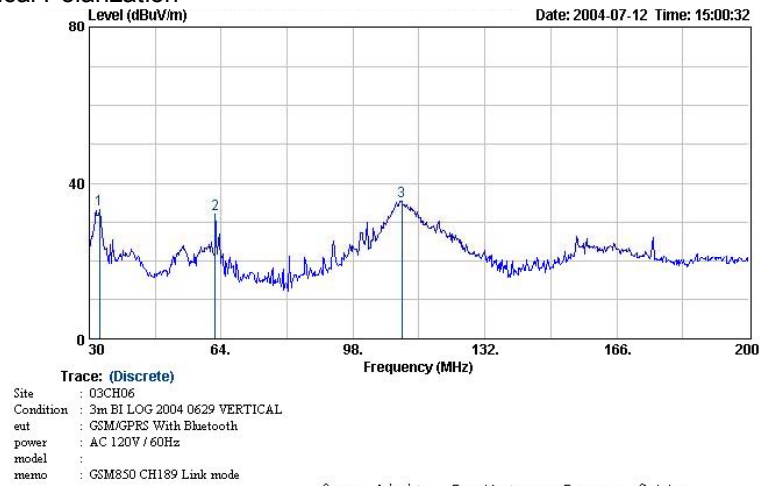

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255

FCC ID

QDJ-0406CHA11

Page No.



53 of 82

Issued Date

July 17, 2004

FCC TEST REPORT

Report No. : F462917

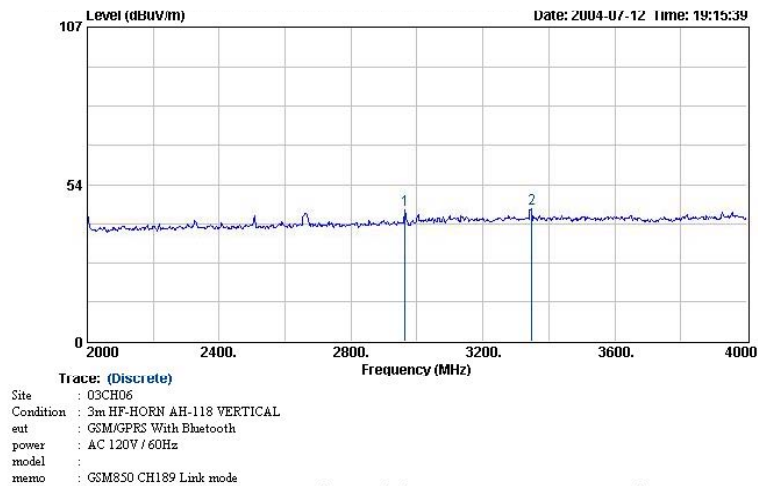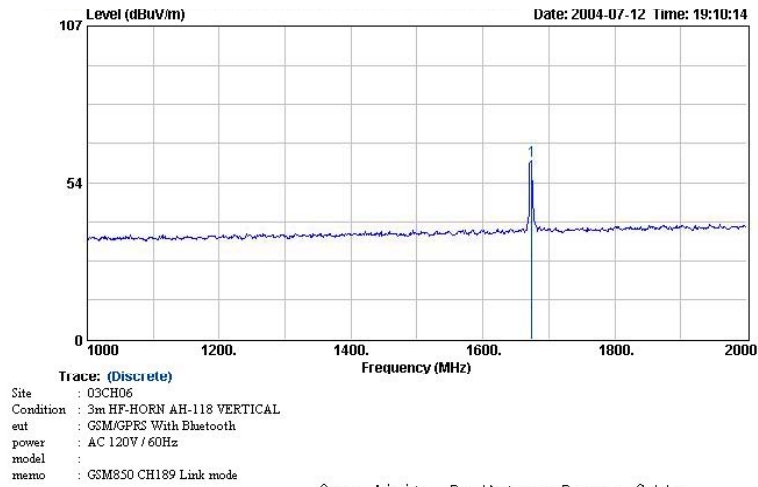

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255

FCC ID

QDJ-0406CHA11

Page No.


54 of 82

Issued Date

July 17, 2004

FCC TEST REPORT

Report No. : F462917

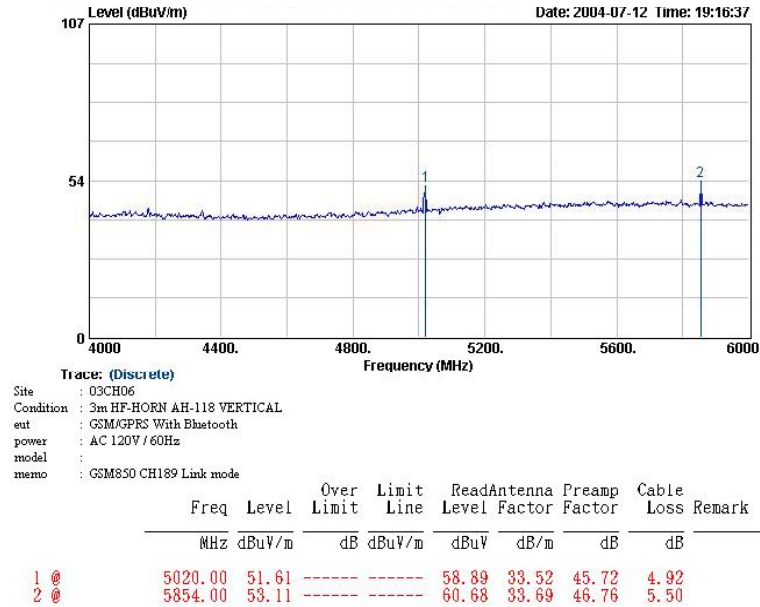


- Mark:
- Frequency from 6GHz to 9GHz, the emission emitted by the EUT is too low to be measured.

FCC TEST REPORT


Report No. : F462917

GSM 850 + BT, Horizontal Polarization (BT)

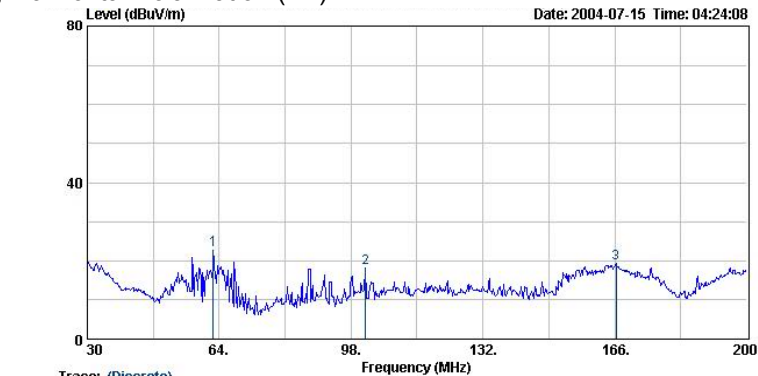

Site : 03CH06
 Condition : 3m BI LOG 2004 0629 HORIZONTAL
 eut : GSM/GPRS With Bluetooth
 power : AC 120V / 60Hz
 model :
 memo : GSM850 CH189 Link mode
 : BT CH00 2402MHz

	Freq	Level	Over	Limit	ReadAntenna	Preamp	Cable	
	MHz	dBuV/m	Limit	Line	Level	Factor	Factor	Loss Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB
1	62.47	22.83	-----	-----	49.36	5.23	32.43	0.67 Peak
2	101.74	18.27	-----	-----	39.13	10.51	32.27	0.89 Peak
3	166.34	19.23	-----	-----	40.95	9.20	32.04	1.12 Peak

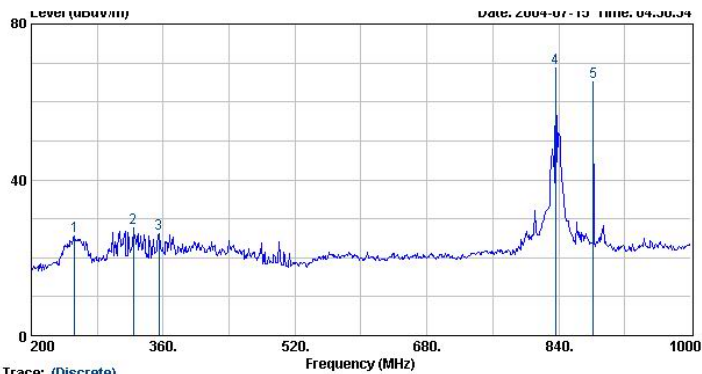

Site : 03CH06
 Condition : 3m BI LOG 2004 0629 HORIZONTAL
 eut : GSM/GPRS With Bluetooth
 power : AC 120V / 60Hz
 model :
 memo : GSM850 CH189 Link mode
 : BT CH00 2402MHz

	Freq	Level	Over	Limit	ReadAntenna	Preamp	Cable	
	MHz	dBuV/m	Limit	Line	Level	Factor	Factor	Loss Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB
1	252.80	25.47	-----	-----	43.64	12.27	31.85	1.41 Peak
2	324.00	27.73	-----	-----	44.59	13.76	32.19	1.58 Peak
3	355.20	26.27	-----	-----	41.61	14.53	31.54	1.68 Peak
4 @	836.00	68.82	-----	-----	77.26	20.35	31.79	3.00 Peak
5 @	881.60	65.00	-----	-----	72.49	20.53	31.00	2.98 Peak

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255

FCC ID

QDJ-0406CHA11

Page No.



56 of 82

Issued Date

July 17, 2004

FCC TEST REPORT

Report No. : F462917

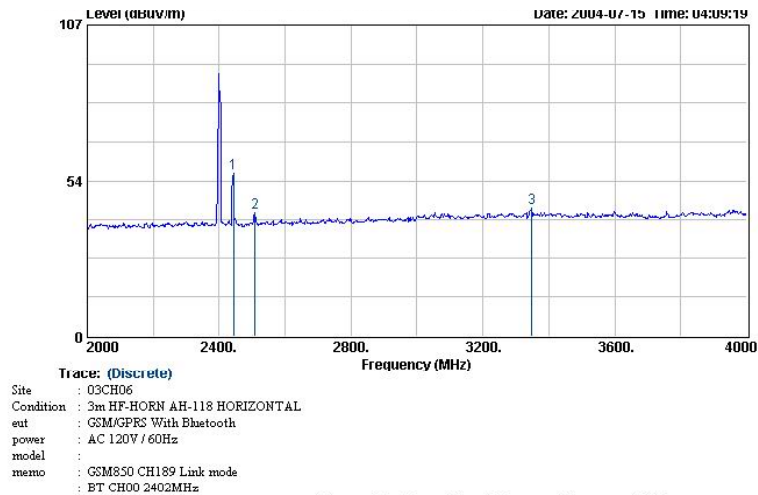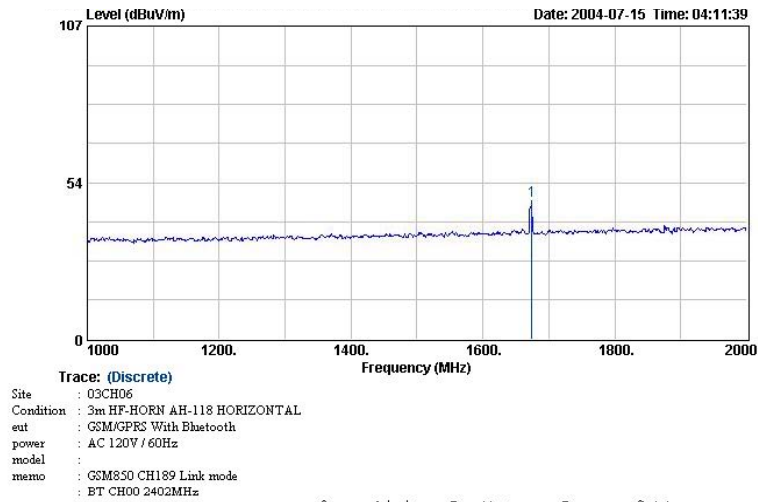

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255

FCC ID


QDJ-0406CHA11

Page No.


57 of 82

Issued Date

July 17, 2004

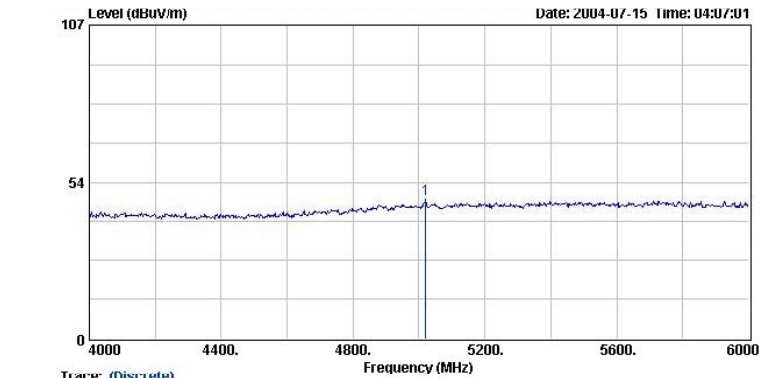

	Freq	Level	Over	Limit	ReadAntenna	Preamp	Cable	
	MHz	dBuV/m	Limit	Line	Level	Factor	Factor	Loss
	MHz	dBuV/m	dB	dBuV/m	dBuV	dB/m	dB	dB
1	5020.00	47.86	-----	-----	55.14	33.52	45.72	4.92 Peak

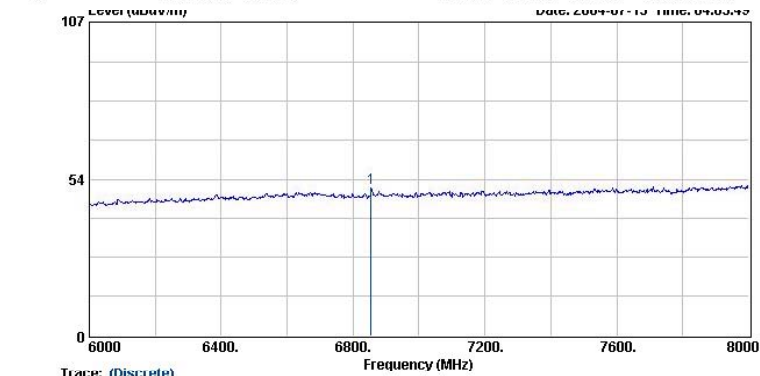


	Freq	Level	Over	Limit	ReadAntenna	Preamp	Cable	
	MHz	dBuV/m	Limit	Line	Level	Factor	Factor	Loss
	MHz	dBuV/m	dB	dBuV/m	dBuV	dB/m	dB	dB
1	6854.00	50.68	-----	-----	56.15	34.67	46.36	6.23 Peak

- Mark:
Frequency from 8GHz to 9GHz, the emission emitted by the EUT is too low to be measured.

FCC TEST REPORT


Report No. : F462917

GSM 850 + BT, Vertical Polarization (BT)

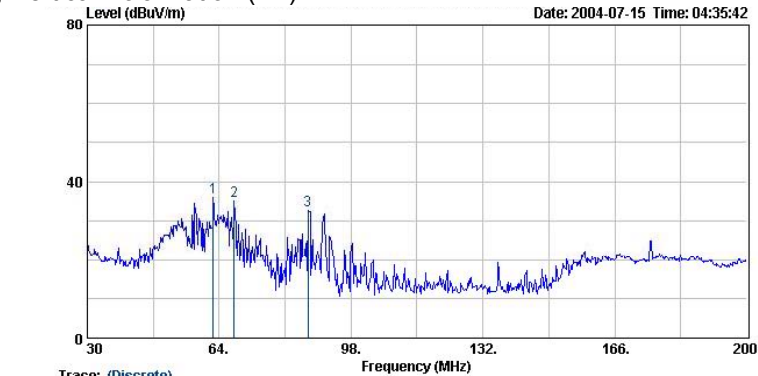

Site : 03CH06
 Condition : 3m BI LOG 2004 0629 VERTICAL
 eut : GSM/GPRS With Bluetooth
 power : AC 120V / 60Hz
 model :
 memo : GSM850 CH189 Link mode
 : BT CH00 2402MHz

	Freq	Level	Over	Limit	ReadAntenna	Preamp	Cable	
	MHz	dBuV/m	Limit	Line	Level	Factor	Loss	Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB
1	62.47	35.84	-----	-----	62.37	5.23	32.43	0.67 Peak
2	67.91	35.20	-----	-----	61.63	5.20	32.34	0.71 Peak
3	86.95	32.58	-----	-----	55.88	8.10	32.22	0.83 Peak

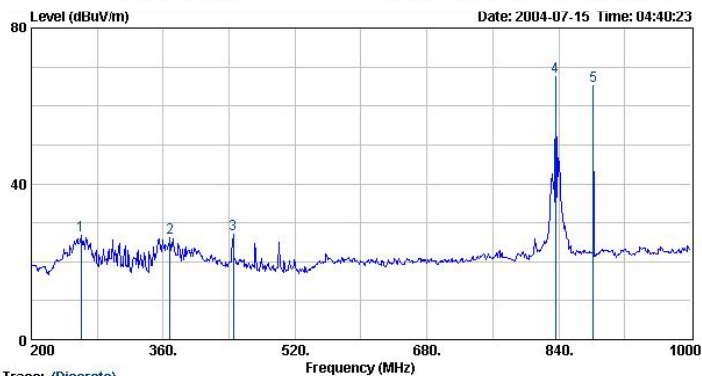

Site : 03CH06
 Condition : 3m BI LOG 2004 0629 VERTICAL
 eut : GSM/GPRS With Bluetooth
 power : AC 120V / 60Hz
 model :
 memo : GSM850 CH189 Link mode
 : BT CH00 2402MHz

	Freq	Level	Over	Limit	ReadAntenna	Preamp	Cable	
	MHz	dBuV/m	Limit	Line	Level	Factor	Loss	Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB
1	260.00	26.69	-----	-----	44.26	12.90	31.89	1.42 Peak
2	368.00	26.18	-----	-----	41.09	14.82	31.45	1.72 Peak
3	444.80	27.18	-----	-----	40.72	16.34	31.79	1.91 Peak
4 @	836.00	67.63	-----	-----	76.07	20.35	31.79	3.00 Peak
5 @	881.60	65.00	-----	-----	72.49	20.53	31.00	2.98 Peak

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255


FCC ID QDJ-0406CHAI1

Page No. 59 of 82

Issued Date July 17, 2004


FCC TEST REPORT

Report No. : F462917

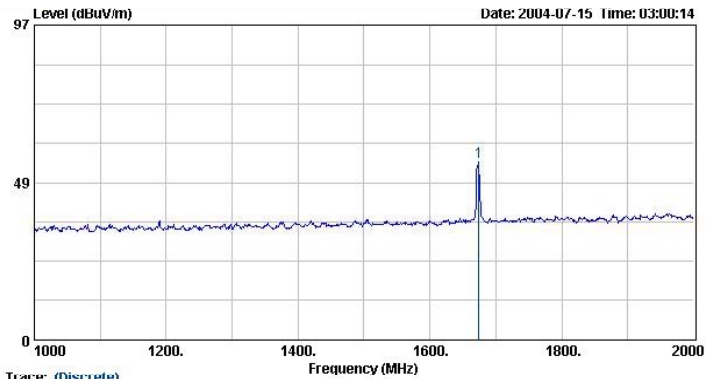

Trace: (Discrete)
 Site : 03CH06
 Condition : 3m HF-HORN AH-118 VERTICAL
 eut : GSM/GPRS With Bluetooth
 power : AC 120V / 60Hz
 model :
 memo : GSM850 CH189 Link mode
 : BT CH00 2402MHz

Freq	Level	Over	Limit	ReadAntenna	Preamp	Cable	
MHz	dBuV/m	Limit	Line	Level	Factor	Factor	Loss
		dB	dBuV/m	dBuV	dB/m	dB	dB
1 @ 1674.00	54.96	-----	-----	70.01	26.42	44.25	2.78 Peak

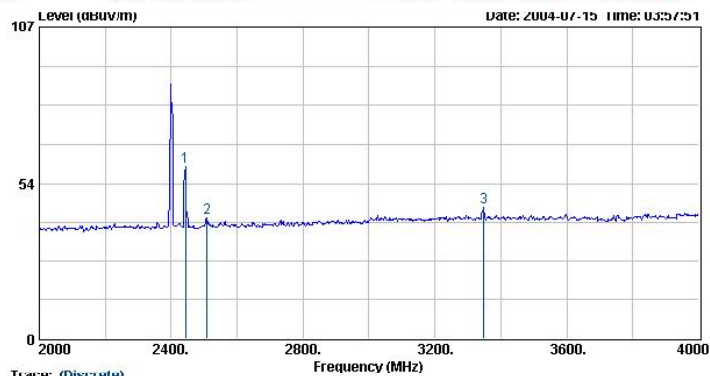

Trace: (Discrete)
 Site : 03CH06
 Condition : 3m HF-HORN AH-118 VERTICAL
 eut : GSM/GPRS With Bluetooth
 power : AC 120V / 60Hz
 model :
 memo : GSM850 CH189 Link mode
 : BT CH00 2402MHz

Freq	Level	Over	Limit	ReadAntenna	Preamp	Cable	
MHz	dBuV/m	Limit	Line	Level	Factor	Factor	Loss
		dB	dBuV/m	dBuV	dB/m	dB	dB
1 @ 2444.00	59.09	-----	-----	71.60	28.45	44.32	3.37 Peak
2 2508.00	41.74	-----	-----	54.09	28.55	44.30	3.39 Peak
3 3348.00	45.35	-----	-----	55.80	30.00	44.38	3.93 Peak

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255

FCC ID


QDJ-0406CHA11

Page No.

60 of 82

Issued Date

July 17, 2004


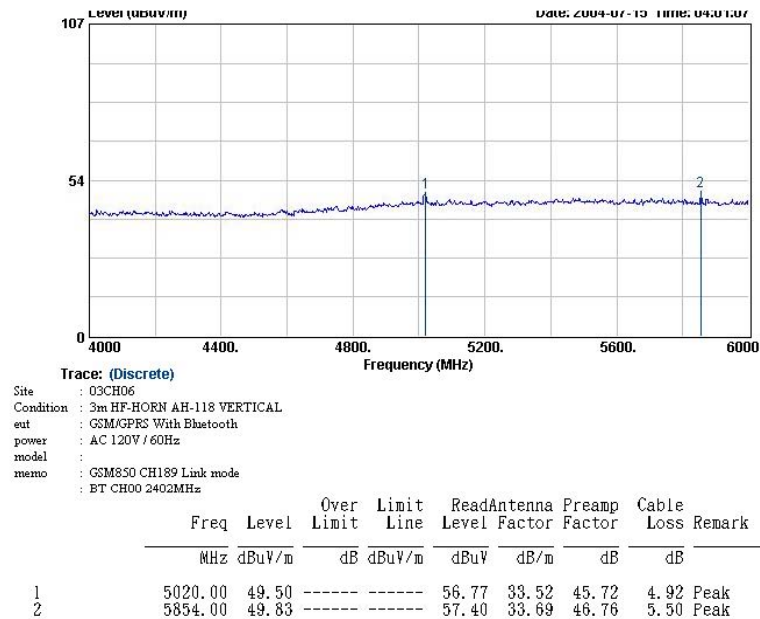


- Mark:
Frequency from 6GHz to 9GHz, the emission emitted by the EUT is too low to be measured.

FCC TEST REPORT

Report No. : F462917

PCS 1900, Horizontal Polarization

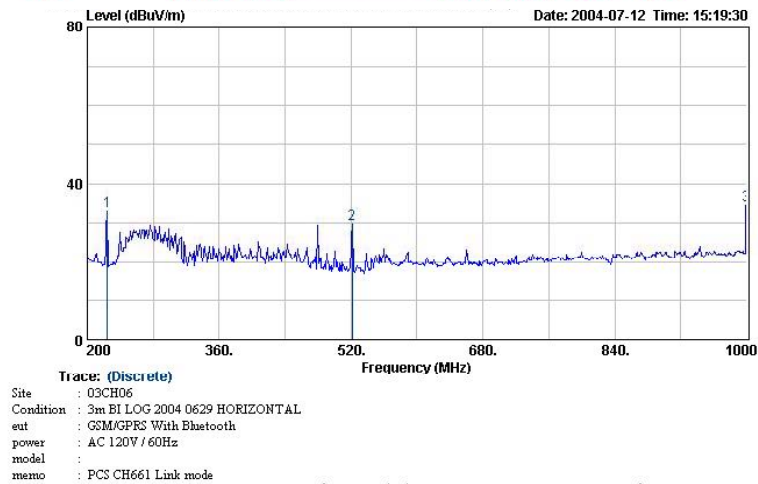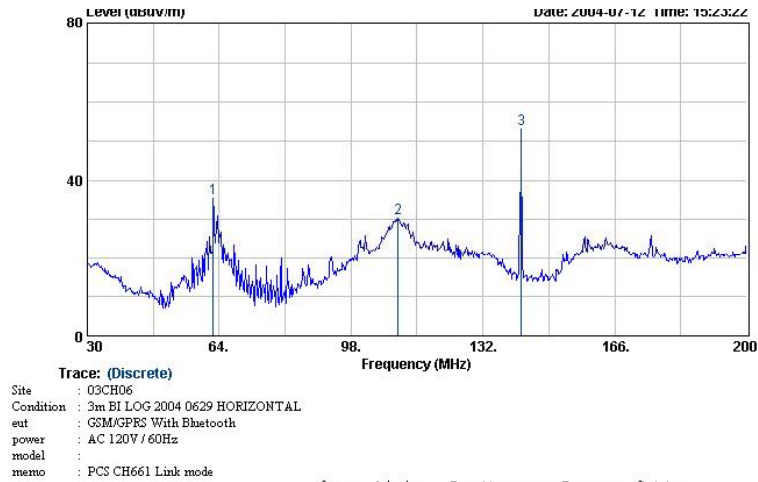

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255

FCC ID

QDJ-0406CHA11

Page No.


62 of 82

Issued Date

July 17, 2004

FCC TEST REPORT

Report No. : F462917

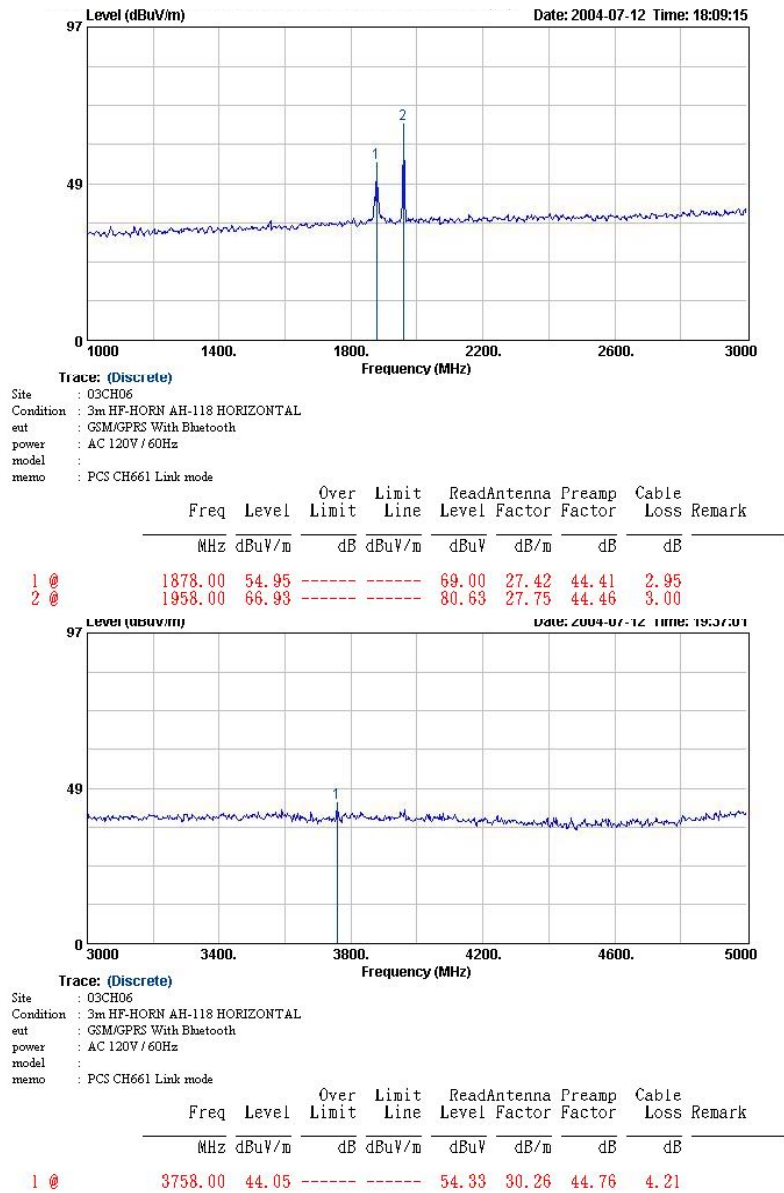

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255

FCC ID

QDJ-0406CHAI1

Page No.


63 of 82

Issued Date

July 17, 2004

FCC TEST REPORT


Report No. : F462917

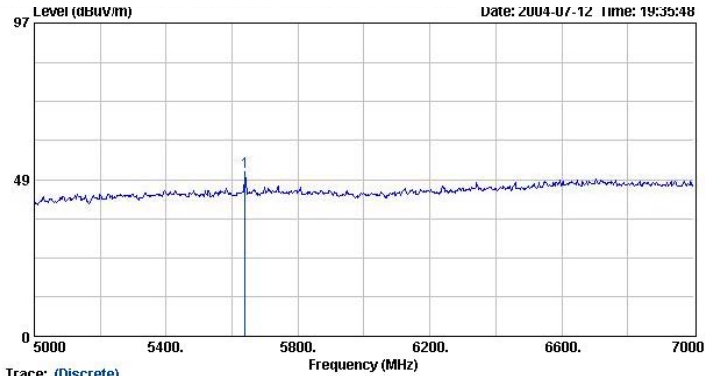

Trace: (Discrete)

Site : 03CH06
 Condition : 3m HF-HORN AH-118 HORIZONTAL
 eut : GSM/GPRS With Bluetooth
 power : AC 120V / 60Hz
 model :
 memo : PCS CH661 Link mode

	Freq	Level	Over	Limit	ReadAntenna	Preamp	Cable	
	MHz	dBuV/m	dB	dBuV/m	Level	Factor	Factor	Loss Remark
					dBuV	dB/m	dB	dB
1 @	5640.00	50.94	-----	-----	58.13	34.01	46.54	5.34

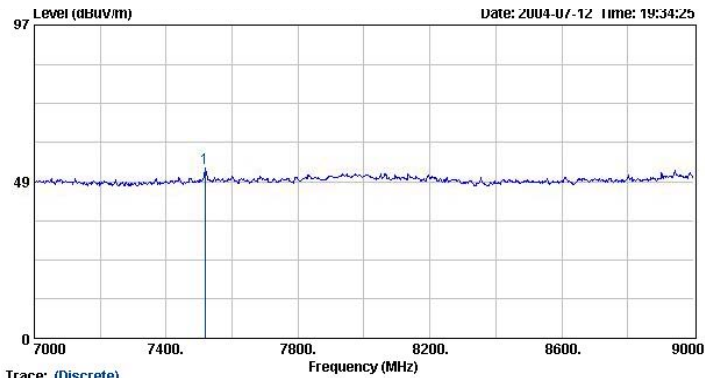

Trace: (Discrete)

Site : 03CH06
 Condition : 3m HF-HORN AH-118 HORIZONTAL
 eut : GSM/GPRS With Bluetooth
 power : AC 120V / 60Hz
 model :
 memo : PCS CH661 Link mode

	Freq	Level	Over	Limit	ReadAntenna	Preamp	Cable	
	MHz	dBuV/m	dB	dBuV/m	Level	Factor	Factor	Loss Remark
					dBuV	dB/m	dB	dB
1 @	7518.00	52.78	-----	-----	56.76	36.03	46.19	6.18

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255

FCC ID


QDJ-0406CHA11

Page No.

64 of 82

Issued Date

July 17, 2004


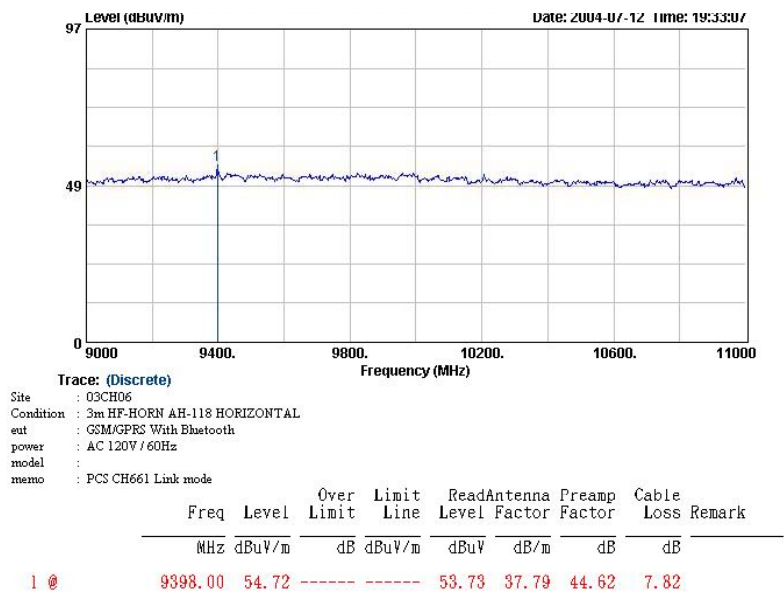


➤ Mark:
Frequency from 11GHz to 19GHz, the emission emitted by the EUT is too low to be measured.

FCC TEST REPORT

Report No. : F462917

PCS 1900, Vertical Polarization

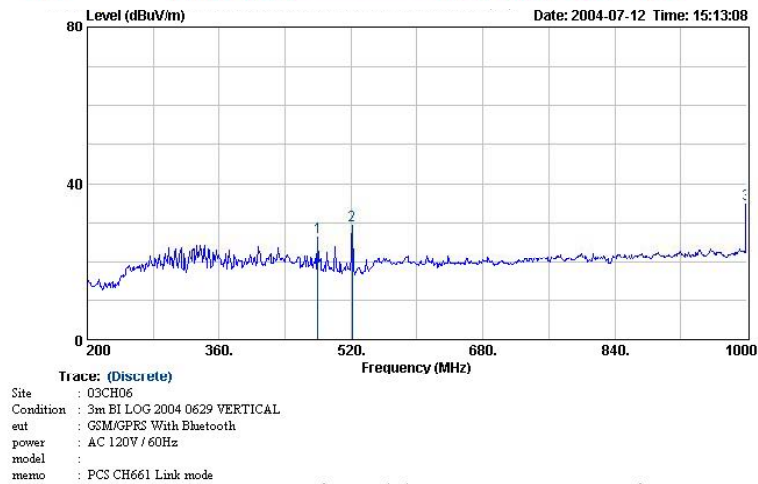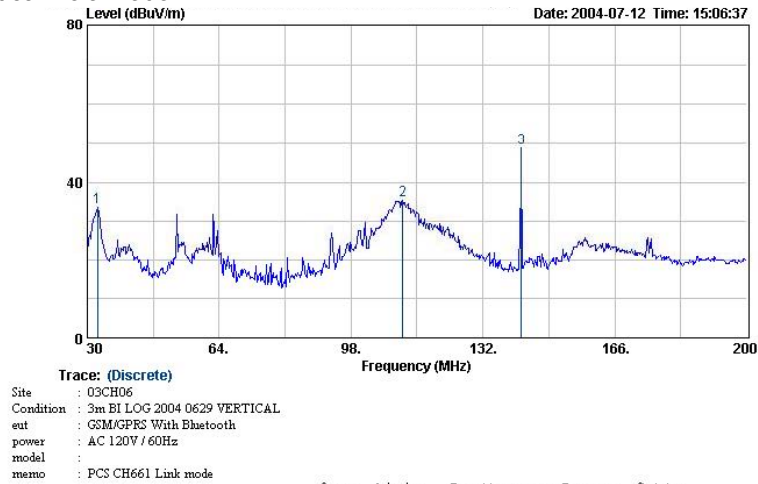

SPORTON International Inc.

TEL : 886-2-2696-2468

FAX : 886-2-2696-2255

FCC ID

QDJ-0406CHA11

Page No.

66 of 82

Issued Date

July 17, 2004