


Appendix D. Band Edge Radiation Data

The data is radiated spurious emissions data in accordance with the test procedures listed in section 4.2 of the report.



No.52 Hwa Ya 1st Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang, Tao Yuan Hsien
Taiwan R.O.C.
tel:+886-3-3273456
http://www.sporton.com.tw

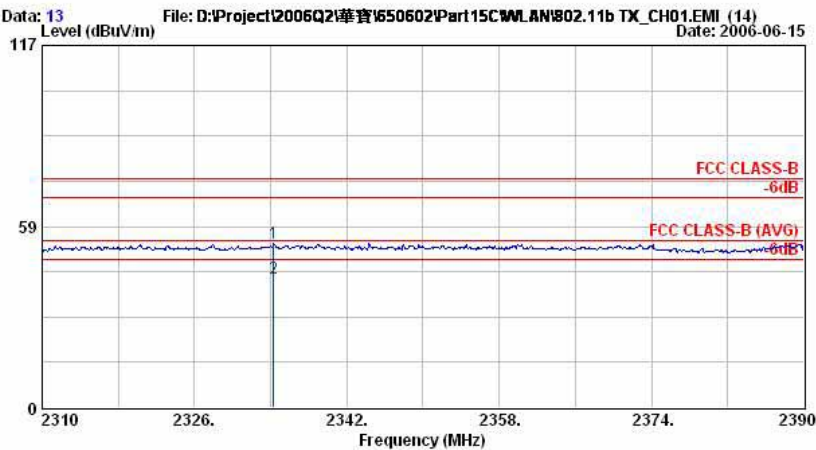


Site : 03CH06-HY
Condition : HF-ANT-060410 HORIZONTAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : 802.11b TX CH01_2412MHz
Plane : E1

	Freq	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Remark
	MHz	dBuV/m	dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg	
1	2334.32	53.14	-20.86	74.00	54.14	30.23	4.17	35.40	100	0	Peak
2	2334.32	41.85	-12.15	54.00	42.85	30.23	4.17	35.40	100	249	Average



No.52 Hwa Ya 1st Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang , Tao Yuan Hsien
Taiwan R.O.C.
tel:+886-3-3273456
http://www.sporton.com.tw

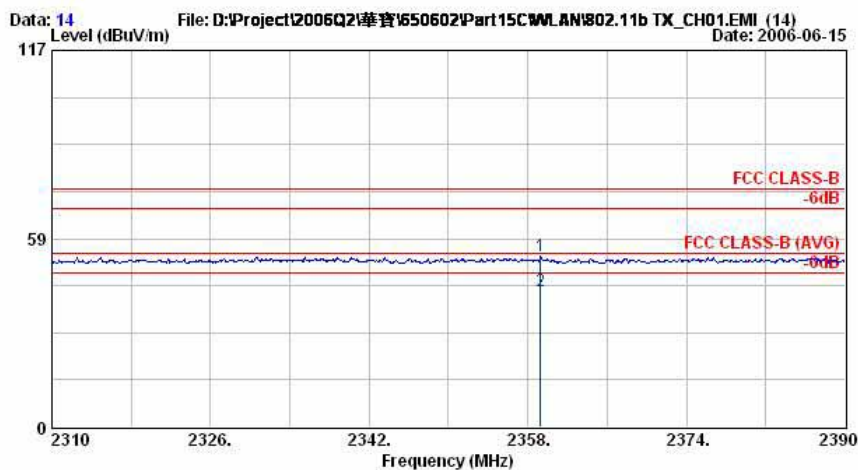


Site : 03CH06-HY
Condition : HF-ANT-060410 VERTICAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : 802.11b TX CH01_2412MHz
Plane : E1

	Freq	Level	Over	Limit	ReadAntenna	Cable	Preamp	Ant	Table	
	MHz	dBuV/m	Limit	Line	Level	Loss	Factor	Pos	Pos	Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg
1	2359.28	53.26	-20.74	74.00	54.23	30.24	4.20	35.42	100	360 Peak
2	2359.28	42.32	-11.68	54.00	43.30	30.24	4.20	35.42	100	215 Average



No.52 Hwa Ya 1st Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang , Tao Yuan Hsien
Taiwan R.O.C.
tel:+886-3-3273456
http://www.sporton.com.tw

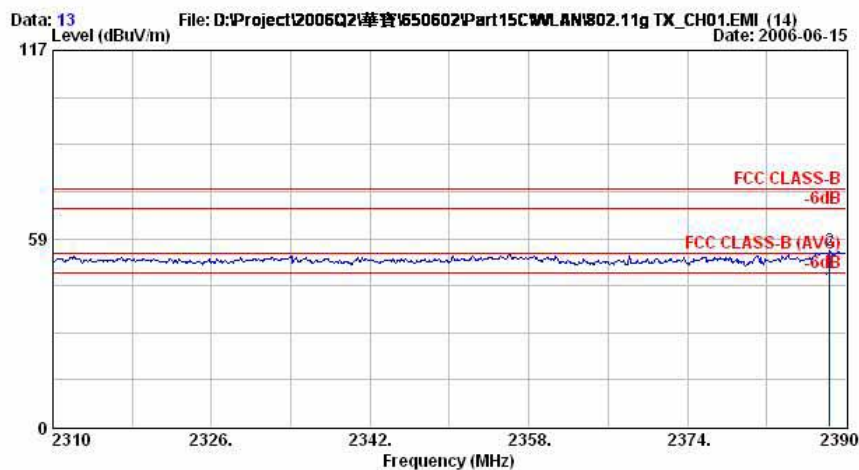


Site : 03CH06-HY
Condition : HF-ANT-060410 VERTICAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : 802.11g TX CH01_2412MHz
Plane : E1

	Freq	Level	Over	Limit	ReadAntenna	Cable	Preamp	Ant	Table	
	MHz	dBuV/m	Limit	Line	Level	Factor	Loss	Factor	Pos	Pos
			dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg
1	2388.32	42.92	-11.08	54.00	43.87	30.26	4.23	35.44	100	253
2	2388.32	54.69	-19.31	74.00	55.64	30.26	4.23	35.44	100	0

Average
Peak



No.52 Hwa Ya 1st Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang , Tao Yuan Hsien
Taiwan R.O.C.
tel:+886-3-3273456
http://www.sporton.com.tw

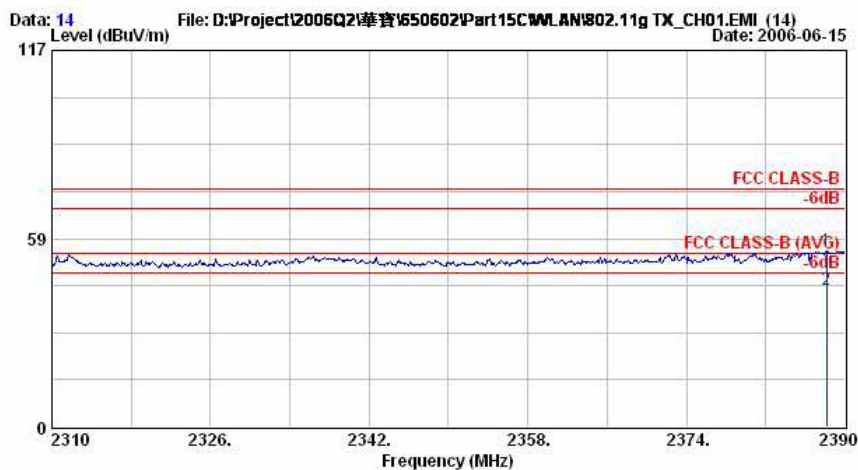


Site : 03CH06-HY
Condition : HF-ANT-060410 HORIZONTAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : 802.11g TX CH01_2412MHz
Plane : E1

	Freq	Level	Over	Limit	ReadAntenna	Cable	Preamp	Ant	Table	
	MHz	dBuV/m	Limit	Line	Level	Loss	Factor	Pos	Pos	Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg
1	2388.16	54.59	-19.41	74.00	55.54	30.26	4.23	35.44	100	0 Peak
2	2388.16	42.60	-11.40	54.00	43.55	30.26	4.23	35.44	100	200 Average



No.52 Hwa Ya 1st Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang , Tao Yuan Hsien
Taiwan R.O.C.
tel:+886-3-3273456
http://www.sporton.com.tw

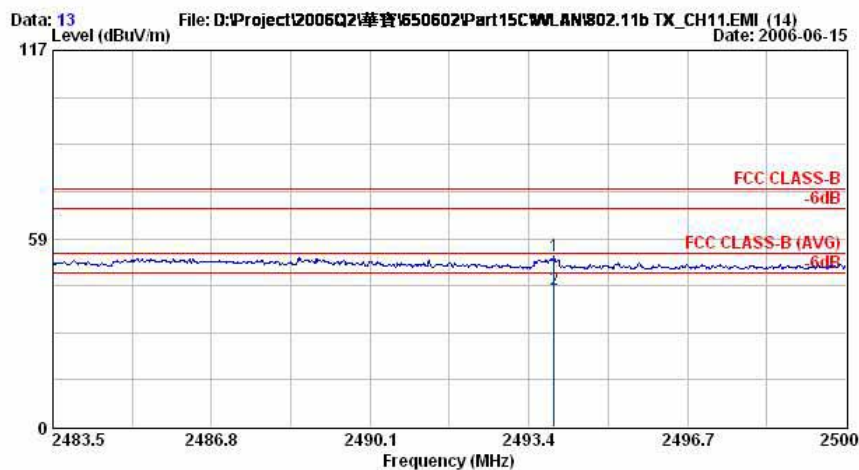


Site : 03CH06-HY
Condition : HF-ANT-060410 HORIZONTAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : 802.11b TX CH11_2462MHz
Plane : E1

	Freq	Level	Over	Limit	ReadAntenna	Cable	Preamp	Ant	Table	
	MHz	dBuV/m	Limit	Line	Level	Loss	Factor	Pos	Pos	Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg
1	2493.93	52.99	-21.01	74.00	53.83	30.30	4.39	35.53	100	0 Peak
2	2493.93	42.46	-11.54	54.00	43.30	30.30	4.39	35.53	100	112 Average



No.52 Hwa Ya 1st Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang , Tao Yuan Hsien
Taiwan R.O.C.
tel:+886-3-3273456
http://www.sporton.com.tw

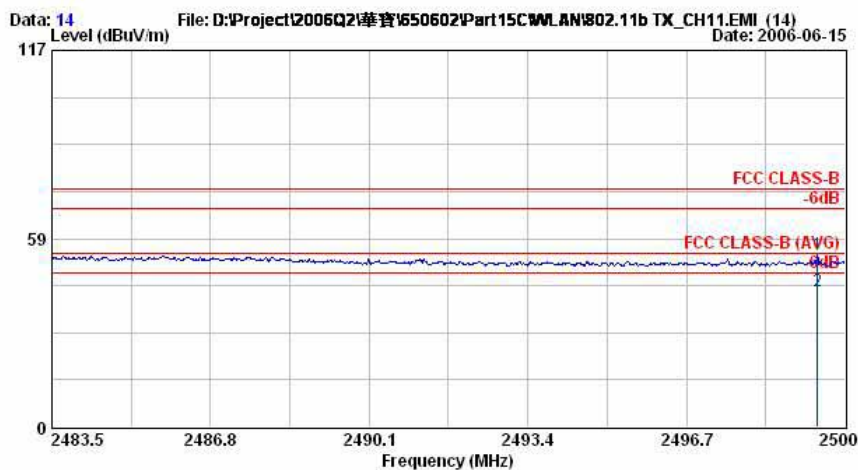


Site : 03CH06-HY
Condition : HF-ANT-060410 VERTICAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : 802.11b TX CH11_2462MHz
Plane : E1

	Freq	Level	Over	Limit	ReadAntenna	Cable	Preamp	Ant	Table	
	MHz	dBuV/m	Limit	Line	Level	Loss	Factor	Pos	Pos	Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg
1	2499.42	53.48	-20.52	74.00	54.32	30.30	4.39	35.53	100	0 Peak
2	2499.42	42.06	-11.94	54.00	42.90	30.30	4.39	35.53	100	248 Average



No.52 Hwa Ya 1st Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang , Tao Yuan Hsien
Taiwan R.O.C.
tel+886-3-3273456
http://www.sporton.com.tw

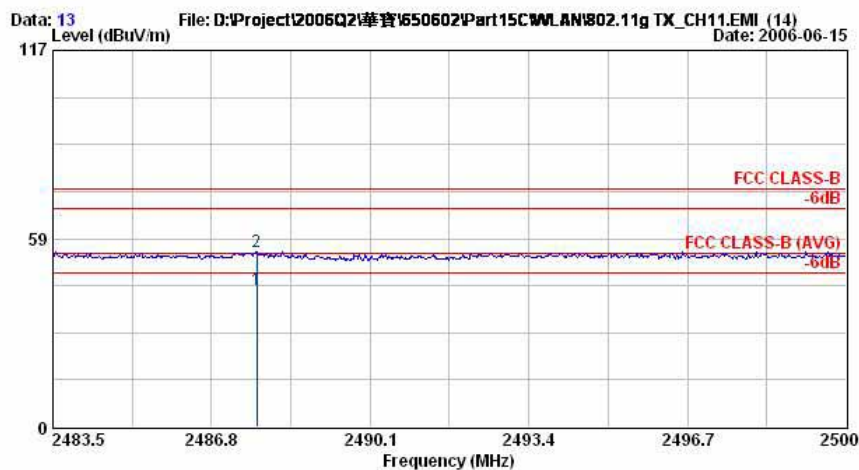


Site : 03CH06-HY
Condition : HF-ANT-060410 HORIZONTAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : 802.11g TX CH11_2462MHz
Plane : E1

	Freq	Level	Over	Limit	ReadAntenna	Cable	Preamp	Ant	Table	
	MHz	dBuV/m	Limit	Line	Level	Loss	Factor	Pos	Pos	Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg
1	2487.74	42.59	-11.41	54.00	43.44	30.30	4.36	35.51	100	209 Average
2	2487.74	54.27	-19.73	74.00	55.12	30.30	4.36	35.51	100	0 Peak



No.52 Hwa Ya 1st Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang , Tao Yuan Hsien
Taiwan R.O.C.
tel:+886-3-3273456
http://www.sporton.com.tw

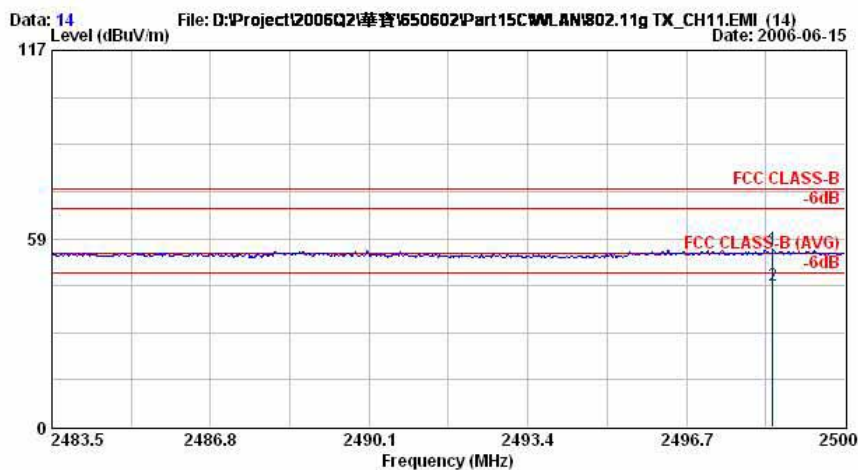


Site : 03CH06-HY
Condition : HF-ANT-060410 VERTICAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : 802.11g TX CH11_2462MHz
Plane : E1

	Freq	Level	Over	Limit	ReadAntenna	Cable	Preamp	Ant	Table	
	MHz	dBuV/m	Limit	Line	Level	Loss	Factor	Pos	Pos	Remark
			dB	dBuV/m	dBuV	dB	dB	cm	deg	
1	2498.50	55.10	-18.90	74.00	55.94	30.30	4.39	35.53	100	0 Peak
2	2498.50	43.75	-10.25	54.00	44.59	30.30	4.39	35.53	100	255 Average



No.52 Hwa Ya 1st Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang, Tao Yuan Hsien
Taiwan R.O.C.
tel:+886-3-3273456
http://www.sporton.com.tw

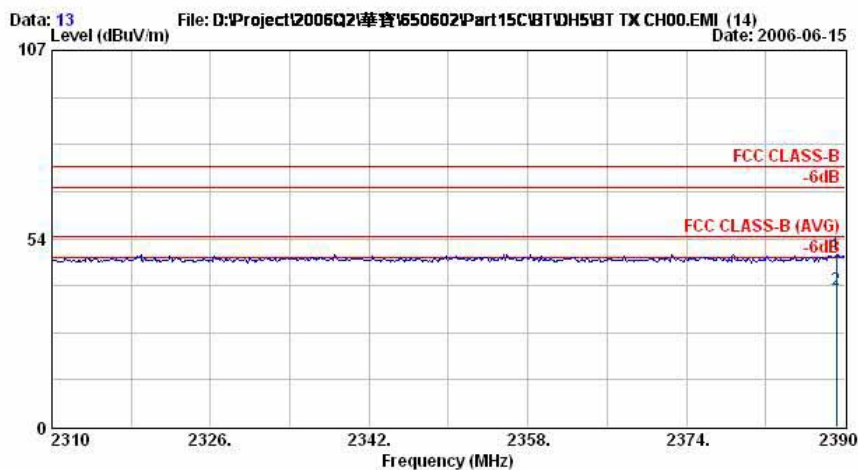


Site : 03CH06-HY
Condition : HF-ANT-060410 VERTICAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : BT TX CH00_2402MHz

	Freq	Level	Over	Limit	ReadAntenna	Cable	Preamp	Ant	Table	
	MHz	dBuV/m	Limit	Line	Level	Loss	Factor	Pos	Pos	Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg
1	2389.12	48.93	-25.07	74.00	49.88	30.26	4.23	35.44	100	360 Peak
2	2389.12	39.10	-14.90	54.00	40.05	30.26	4.23	35.44	106	275 Average



No.52 Hwa Ya 1st Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang, Tao Yuan Hsien
Taiwan R.O.C.
tel:+886-3-3273456
http://www.sporton.com.tw

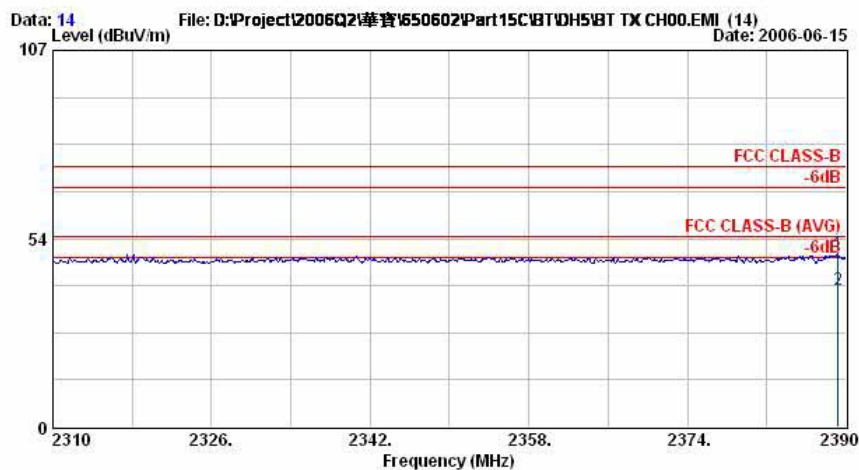


Site : 03CH06-HY
Condition : HF-ANT-060410 HORIZONTAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : BT TX CH00_2402MHz

	Freq	Level	Over	Limit	ReadAntenna	Cable	Preamp	Ant	Table	
	MHz	dBuV/m	Limit	Line	Level	Loss	Factor	Pos	Pos	Remark
	MHz	dBuV/m	dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg
1	2389.20	49.27	-24.73	74.00	50.22	30.26	4.23	35.44	100	360 Peak
2	2389.20	38.84	-15.16	54.00	39.79	30.26	4.23	35.44	106	160 Average



No.52 Hwa Ya 1St Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang , Tao Yuan Hsien
Taiwan R.O.C.
tel:+886-3-3273456
http://www.sporton.com.tw

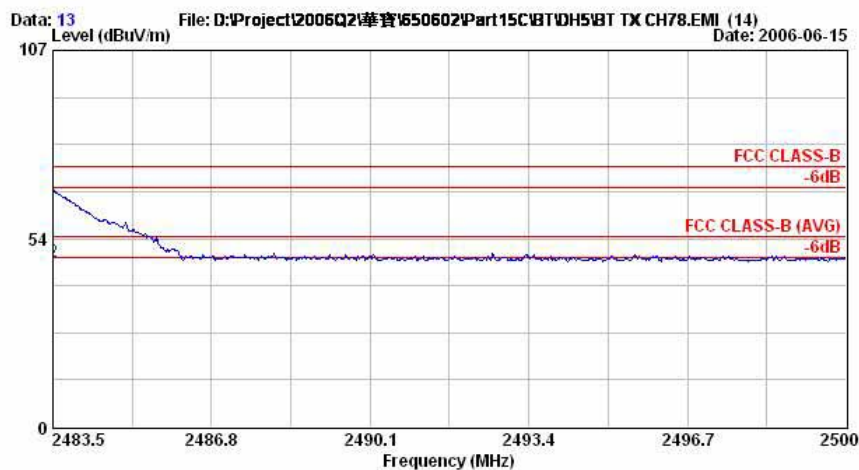


Site : 03CH06-HY
Condition : HF-ANT-060410 HORIZONTAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : BT TX CH78_2480MHz

	Freq	Level	Over	Limit	ReadAntenna	Cable	Preamp	Ant	Table	
	MHz	dBuV/m	Limit	Line	Level	Loss	Factor	Pos	Pos	Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg
1	2483.50	67.38	-6.62	74.00	68.24	30.29	4.36	35.51	100	0 Peak
2	2483.50	47.09	-6.91	54.00	47.95	30.29	4.36	35.51	100	157 Average



No.52 Hwa Ya 1St Rd., Hwa Ya Technology
Park,Kwei-Shan Hsiang , Tao Yuan Hsien
Taiwan R.O.C.
tel+886-3-3273456
http://www.sporton.com.tw

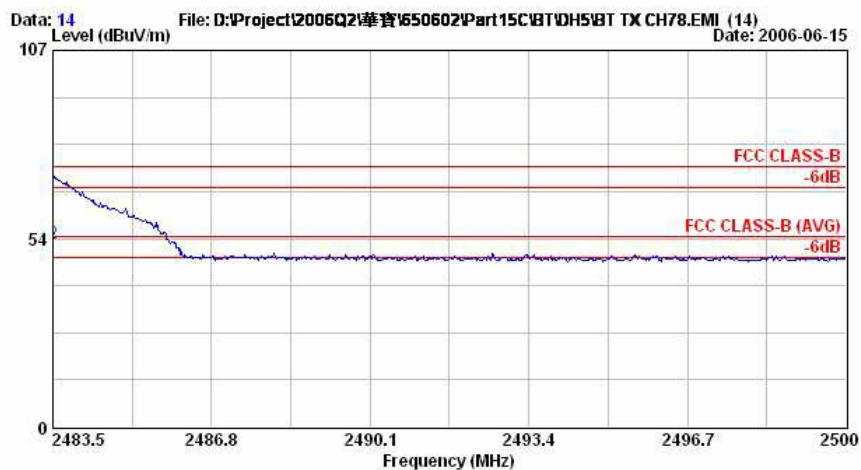

Site : 03CH06-HY
Condition : HF-ANT-060410 VERTICAL
EUT : PDA Phone
Power : 120Vac/60Hz,SUNFONE(MODEL:ACE05V1A)
Model : FR650602
Memo : BT TX CH78_2480MHz

	Freq	Level	Over	Limit	ReadAntenna	Cable	Preamp	Ant	Table	
	MHz	dBuV/m	Limit	Line	Level	Loss	Factor	Pos	Pos	Remark
			dB	dBuV/m	dBuV	dB/m	dB	dB	cm	deg
1 !	2483.50	71.15	-2.85	74.00	72.01	30.29	4.36	35.51	100	0 Peak
2 @	2483.50	51.94	-2.06	54.00	52.80	30.29	4.36	35.51	100	137 Average