



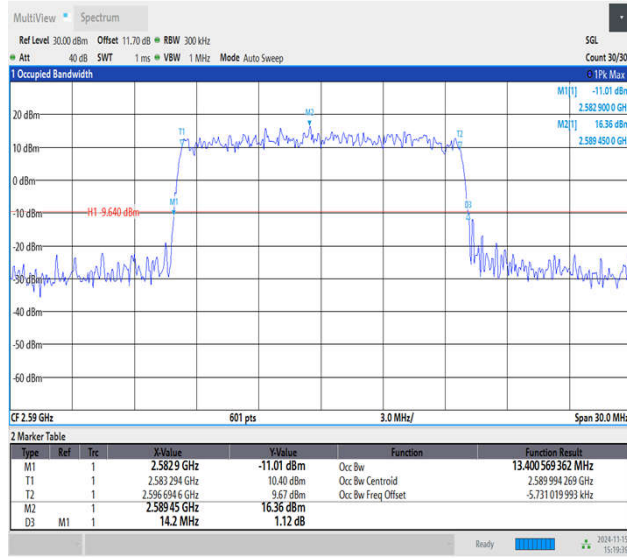


03:19:40 PM 11/15/2024

41(2535-2655)-15MHz-16QAM-40590-75RB#0-PASS

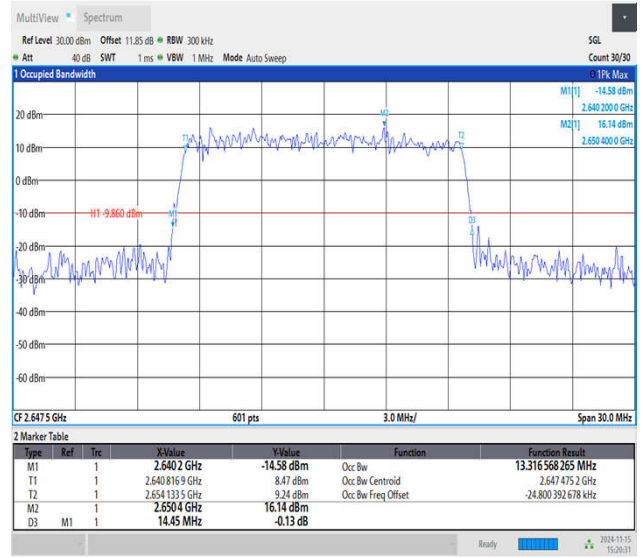


03:20:32 PM 11/15/2024

41(2535-2655)-15MHz-16QAM-41165-75RB#0-PASS

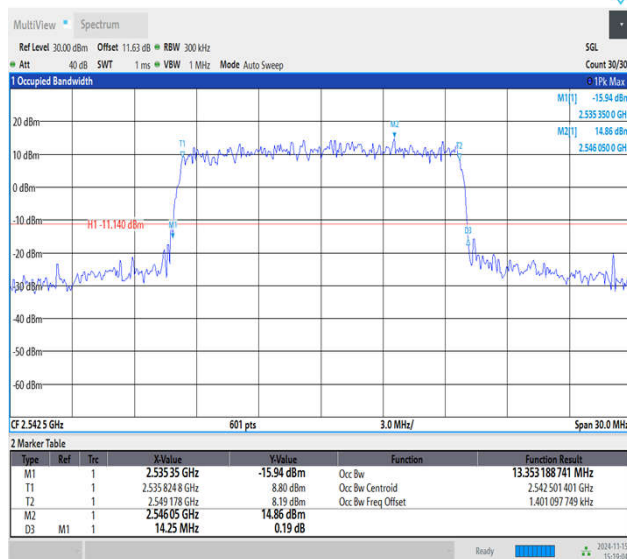


03:19:05 PM 11/15/2024

41(2535-2655)-15MHz-64QAM-40115-75RB#0-PASS

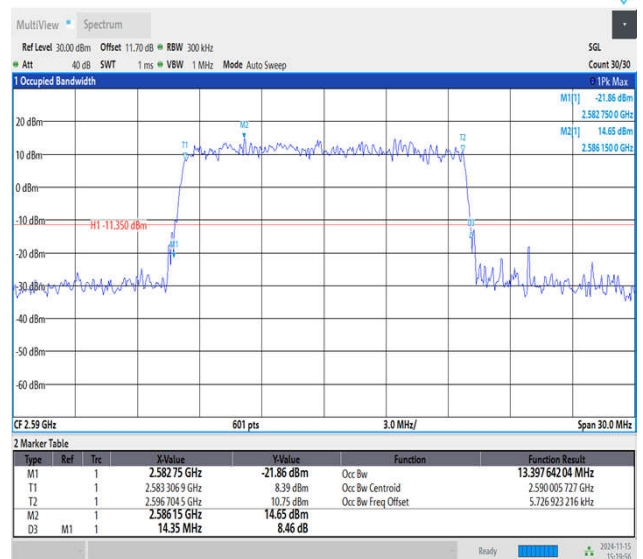


03:19:57 PM 11/15/2024

41(2535-2655)-15MHz-64QAM-40590-75RB#0-PASS

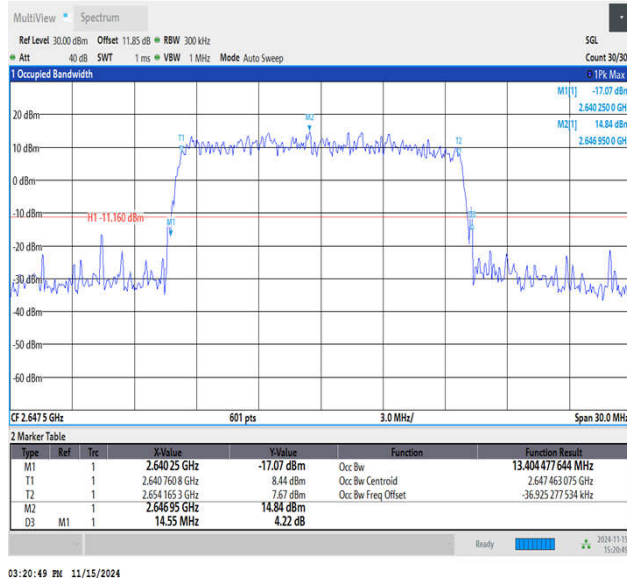


03:20:49 PM 11/15/2024

41(2535-2655)-15MHz-64QAM-41165-75RB#0-PASS

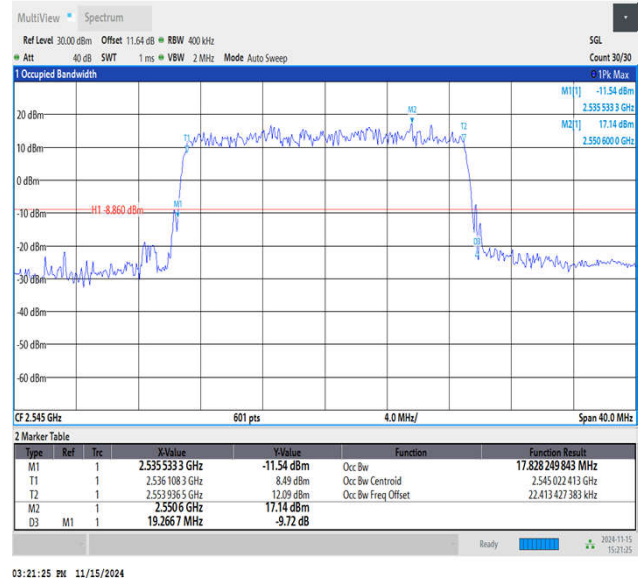


03:21:25 PM 11/15/2024

41(2535-2655)-20MHz-QPSK-40140-100RB#0-PASS

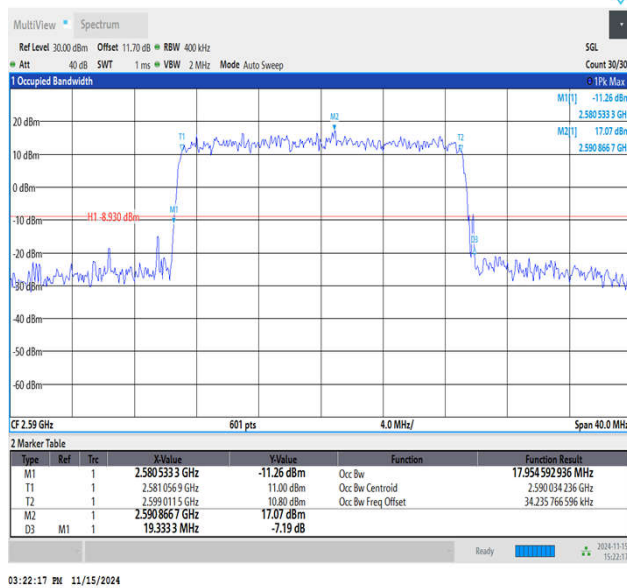


03:22:17 PM 11/15/2024

41(2535-2655)-20MHz-QPSK-40590-100RB#0-PASS

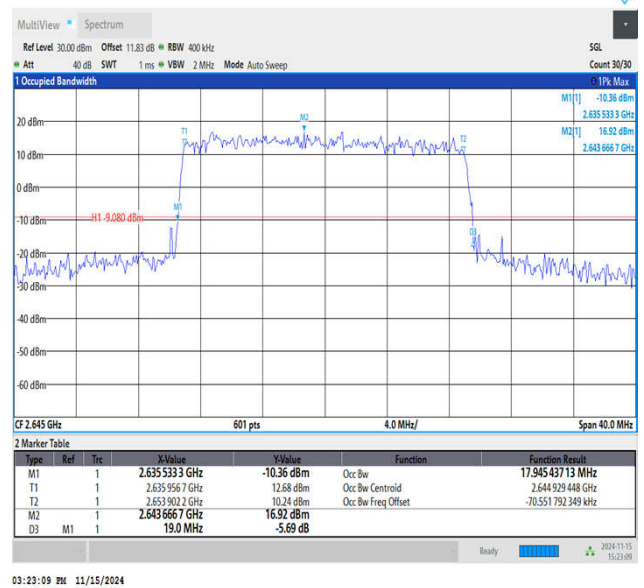


03:23:09 PM 11/15/2024

41(2535-2655)-20MHz-QPSK-41140-100RB#0-PASS

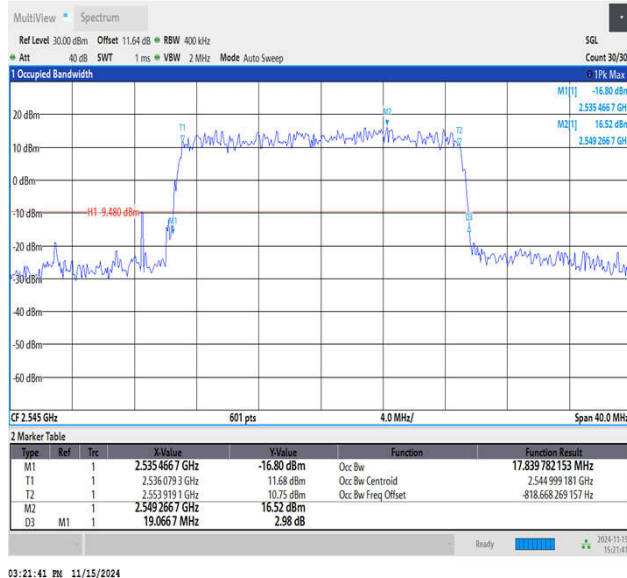


03:21:41 PM 11/15/2024

41(2535-2655)-20MHz-16QAM-40140-100RB#0-PASS

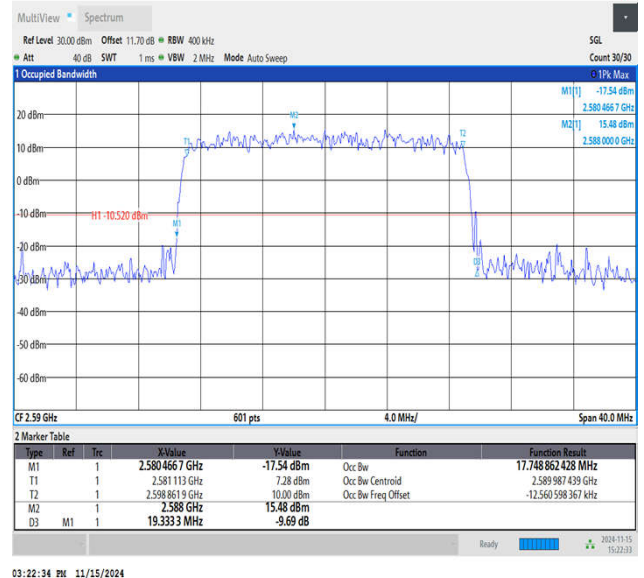


03:22:34 PM 11/15/2024

41(2535-2655)-20MHz-16QAM-40590-100RB#0-PASS

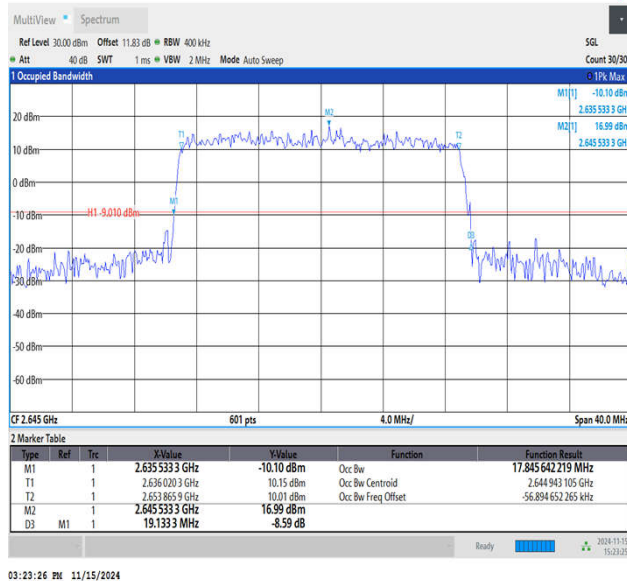



03:23:26 PM 11/15/2024

41(2535-2655)-20MHz-16QAM-41140-100RB#0-PASS

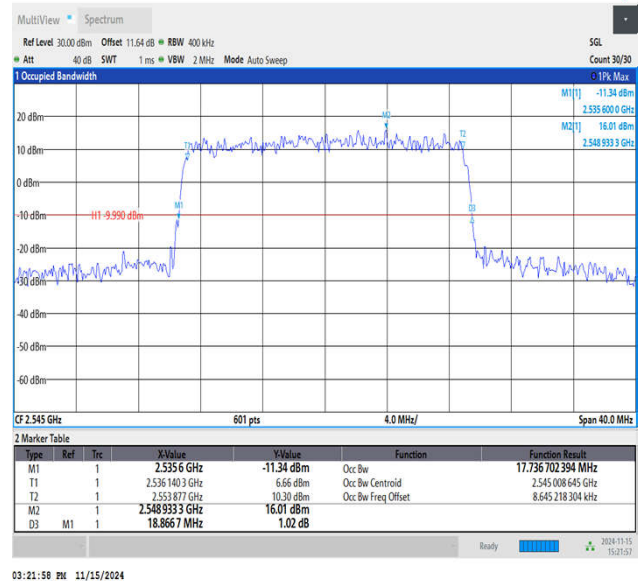

03:21:58 PM 11/15/2024

41(2535-2655)-20MHz-64QAM-40140-100RB#0-PASS

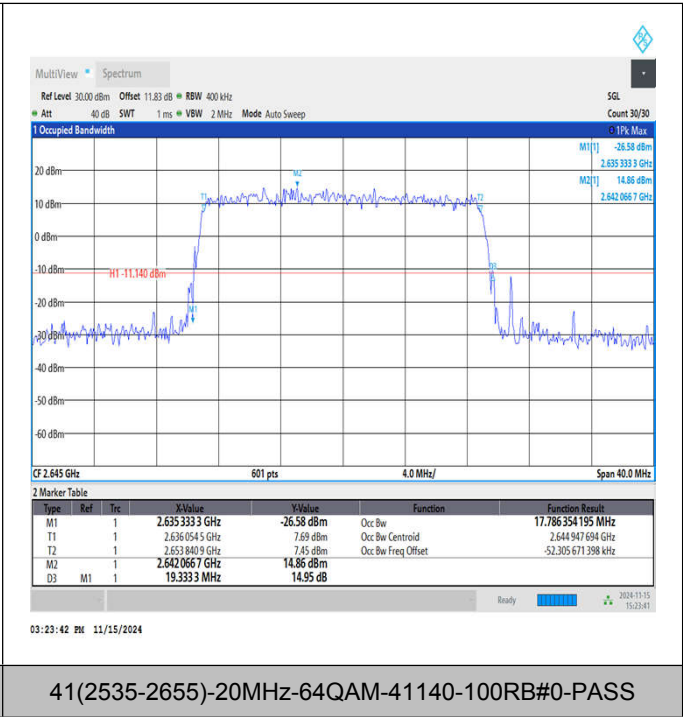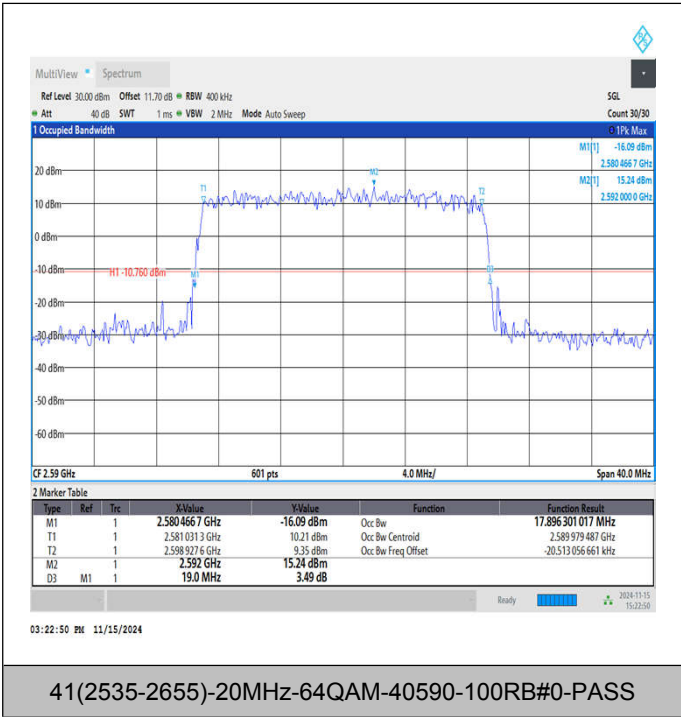

1.4 Band Edge


1.4.1 Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
41(2535-2655)	5MHz	QPSK	40065	1RB#0	-20.17	PASS
41(2535-2655)	5MHz	QPSK	40065	1RB#24	-45.04	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	-26.34	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#0	-48.69	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#24	-16.87	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	-25.14	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#0	-18.72	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#24	-45.71	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	-27.93	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#0	-48.67	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#24	-19.64	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	-25.21	PASS
41(2535-2655)	5MHz	64QAM	40065	1RB#0	-22.46	PASS
41(2535-2655)	5MHz	64QAM	40065	1RB#24	-45.93	PASS
41(2535-2655)	5MHz	64QAM	40065	25RB#0	-26.71	PASS
41(2535-2655)	5MHz	64QAM	41215	1RB#0	-48.74	PASS
41(2535-2655)	5MHz	64QAM	41215	1RB#24	-17.54	PASS
41(2535-2655)	5MHz	64QAM	41215	25RB#0	-26.58	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#0	-29.83	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#49	-36.95	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	-26.84	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#0	-45.70	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#49	-26.68	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	-40.43	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#0	-28.67	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#49	-37.99	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	-29.32	PASS
41(2535-2655)	10MHz	16QAM	41190	1RB#0	-45.79	PASS

41(2535-2655)	10MHz	16QAM	41190	1RB#49	-28.83	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	-41.33	PASS
41(2535-2655)	10MHz	64QAM	40090	1RB#0	-30.07	PASS
41(2535-2655)	10MHz	64QAM	40090	1RB#49	-41.16	PASS
41(2535-2655)	10MHz	64QAM	40090	50RB#0	-30.05	PASS
41(2535-2655)	10MHz	64QAM	41190	1RB#0	-45.77	PASS
41(2535-2655)	10MHz	64QAM	41190	1RB#49	-29.00	PASS
41(2535-2655)	10MHz	64QAM	41190	50RB#0	-43.29	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#0	-25.55	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#74	-35.22	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	-31.14	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#0	-43.98	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#74	-23.42	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	-40.01	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#0	-25.64	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#74	-36.56	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	-30.70	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#0	-44.16	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#74	-25.75	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	-40.75	PASS
41(2535-2655)	15MHz	64QAM	40115	1RB#0	-30.59	PASS
41(2535-2655)	15MHz	64QAM	40115	1RB#74	-39.85	PASS
41(2535-2655)	15MHz	64QAM	40115	75RB#0	-30.93	PASS
41(2535-2655)	15MHz	64QAM	41165	1RB#0	-44.12	PASS
41(2535-2655)	15MHz	64QAM	41165	1RB#74	-24.46	PASS
41(2535-2655)	15MHz	64QAM	41165	75RB#0	-42.12	PASS
41(2535-2655)	20MHz	QPSK	40140	1RB#0	-27.14	PASS
41(2535-2655)	20MHz	QPSK	40140	1RB#99	-51.73	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	-30.98	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#0	-41.92	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#99	-24.91	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	-38.39	PASS
41(2535-2655)	20MHz	16QAM	40140	1RB#0	-27.68	PASS
41(2535-2655)	20MHz	16QAM	40140	1RB#99	-51.77	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	-30.92	PASS


41(2535-2655)	20MHz	16QAM	41140	1RB#0	-41.95	PASS
41(2535-2655)	20MHz	16QAM	41140	1RB#99	-41.91	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	-38.59	PASS
41(2535-2655)	20MHz	64QAM	40140	1RB#0	-27.94	PASS
41(2535-2655)	20MHz	64QAM	40140	1RB#99	-51.76	PASS
41(2535-2655)	20MHz	64QAM	40140	100RB#0	-31.01	PASS
41(2535-2655)	20MHz	64QAM	41140	1RB#0	-41.93	PASS
41(2535-2655)	20MHz	64QAM	41140	1RB#99	-41.81	PASS
41(2535-2655)	20MHz	64QAM	41140	100RB#0	-40.15	PASS

1.4.2 Test Graphs

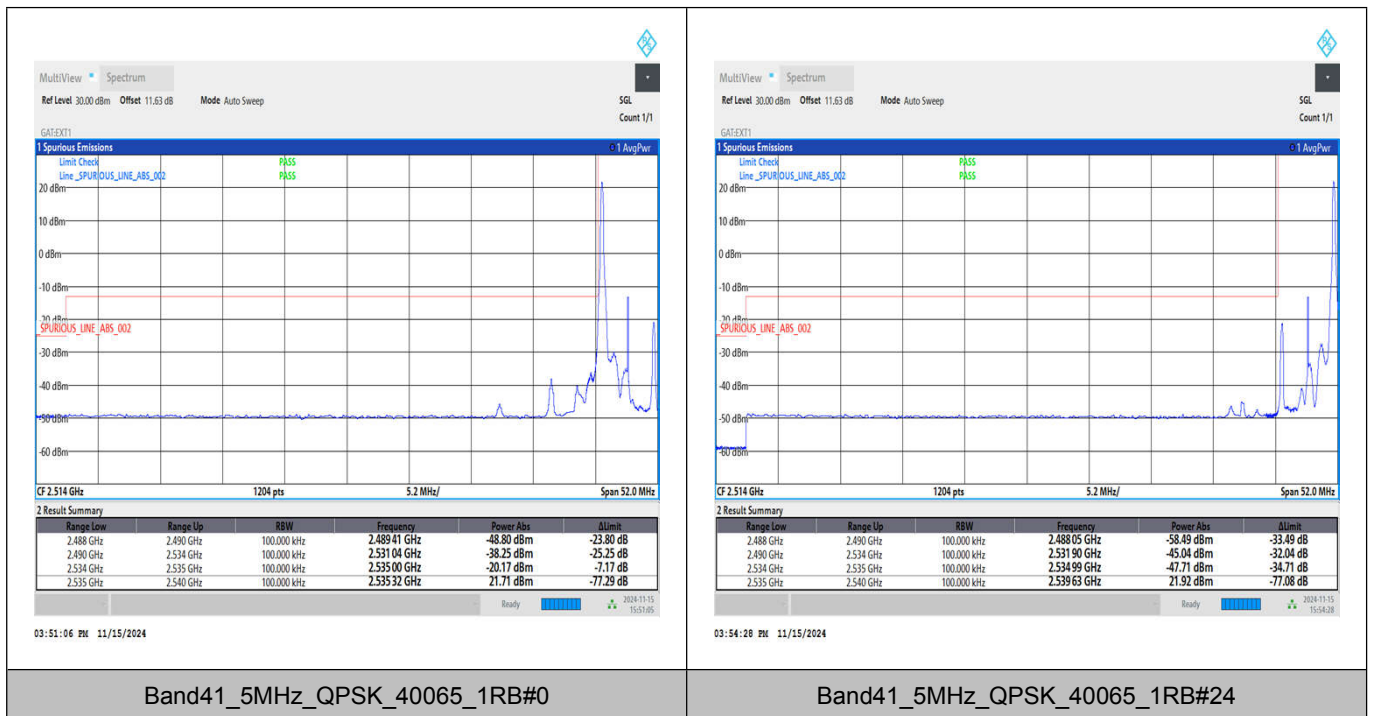


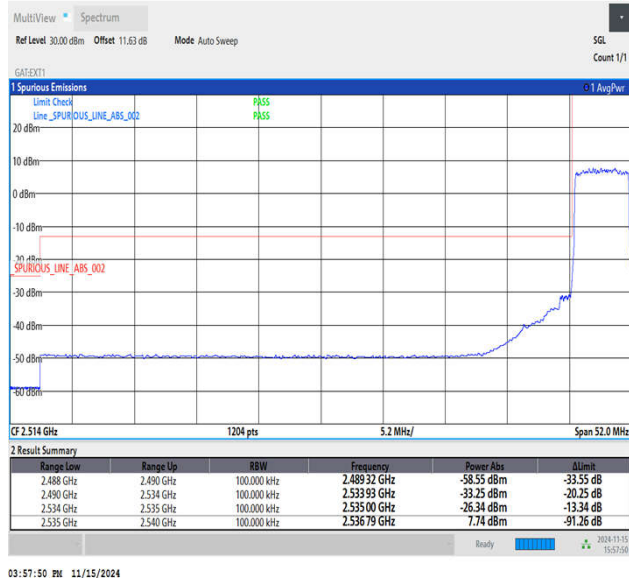


Band41_5MHz_QPSK_40065_25RB#0

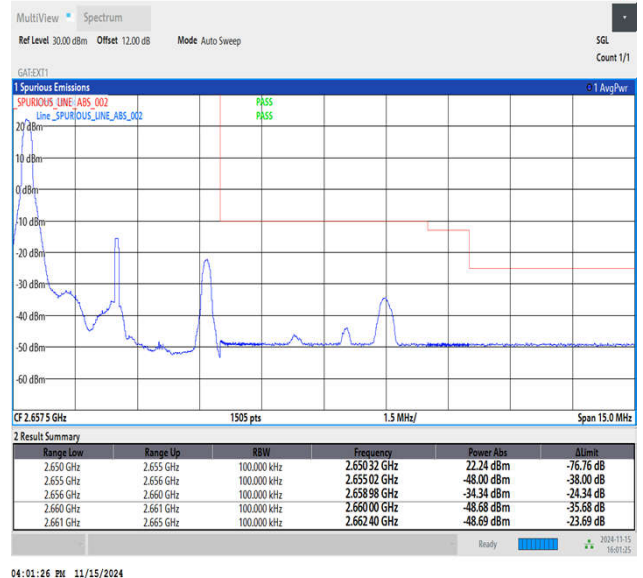


Band41_5MHz_QPSK_41215_1RB#0

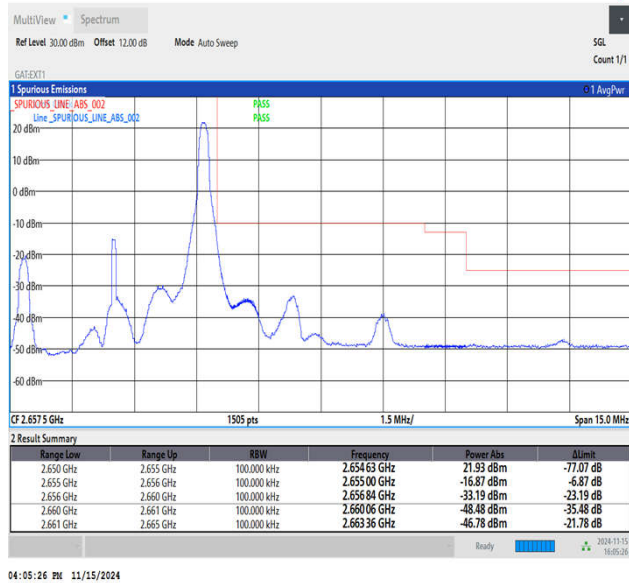

Band41_5MHz_QPSK_41215_1RB#24

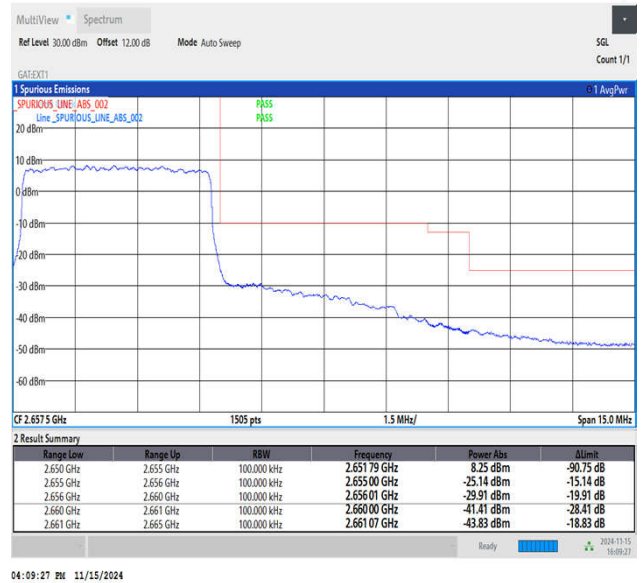


Band41_5MHz_QPSK_41215_25RB#0

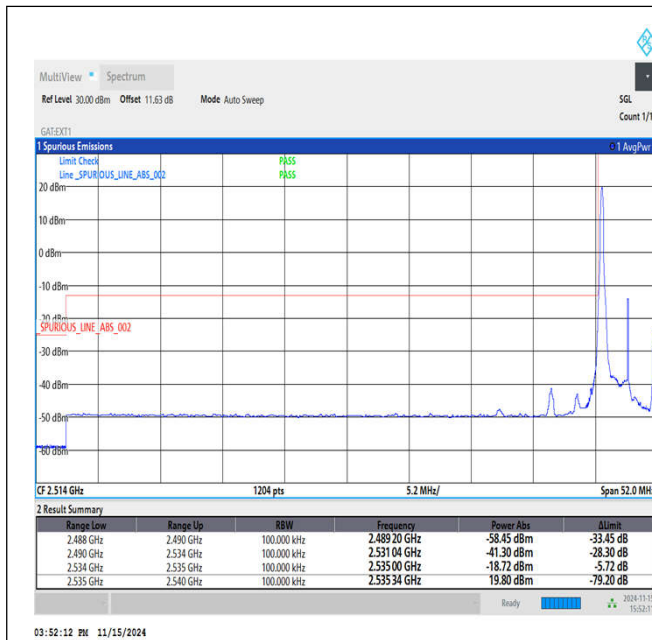


Band41_5MHz_16QAM_40065_1RB#0




Band41_5MHz_16QAM_40065_1RB#24

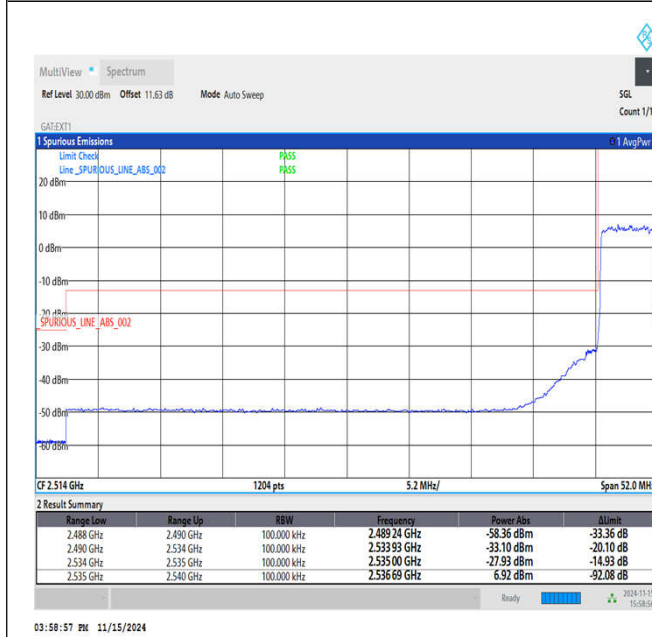


Band41_5MHz_16QAM_40065_25RB#0

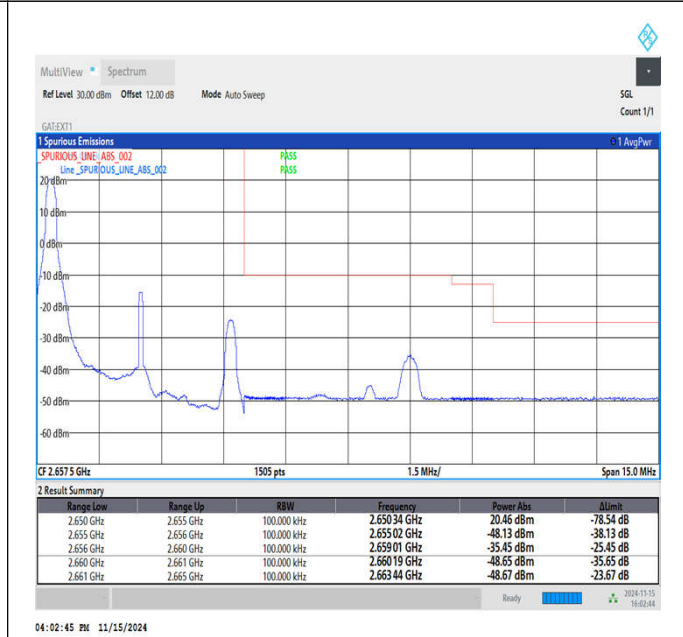


Band41_5MHz_16QAM_41215_1RB#0

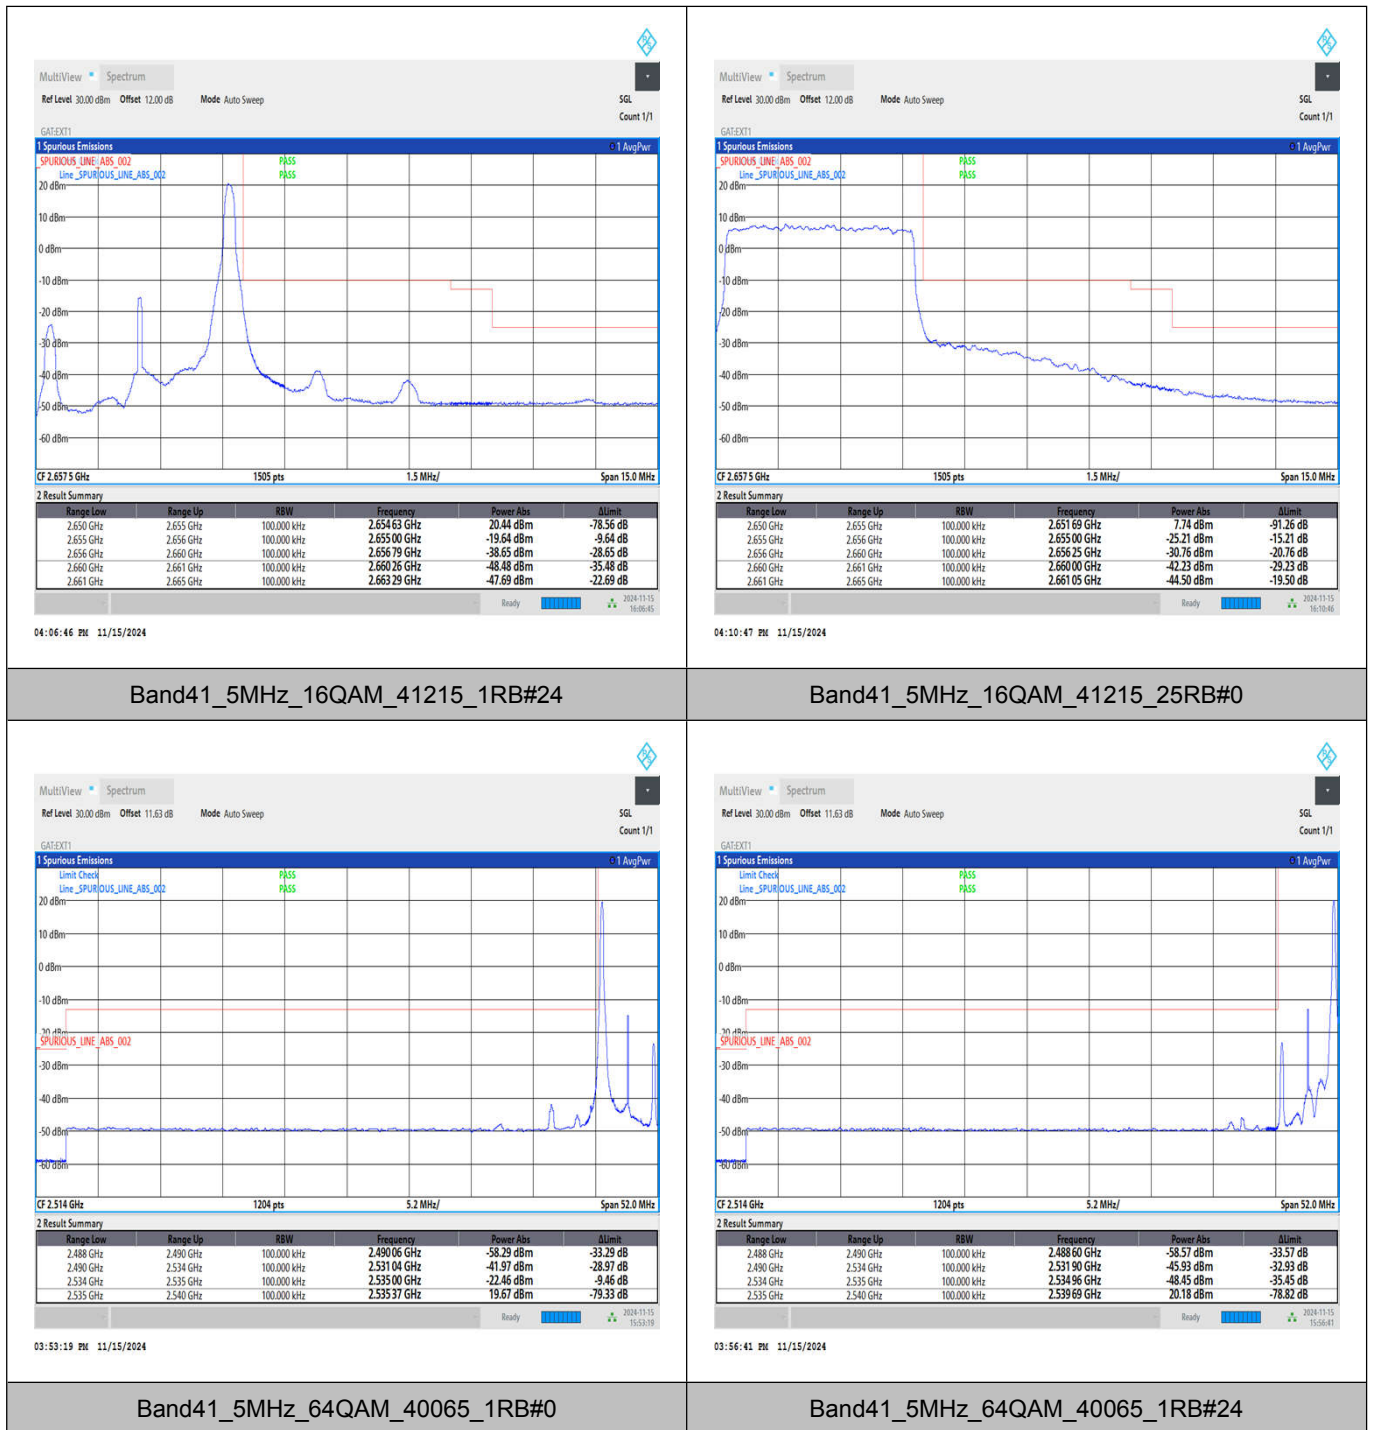


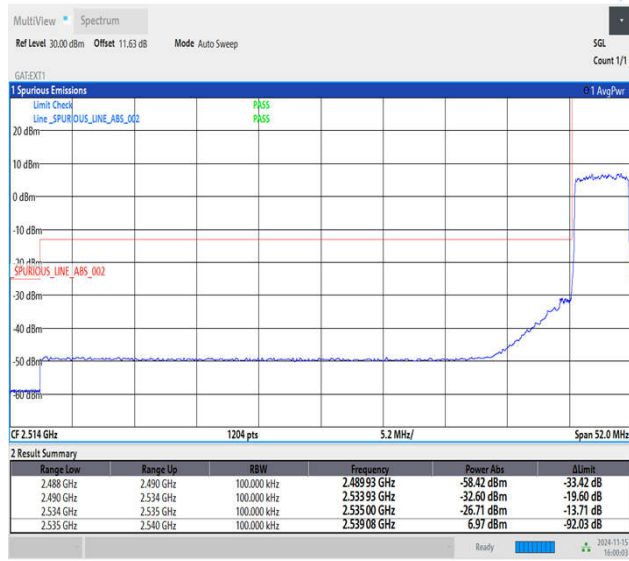


Band41_5MHz_64QAM_40065_25RB#0

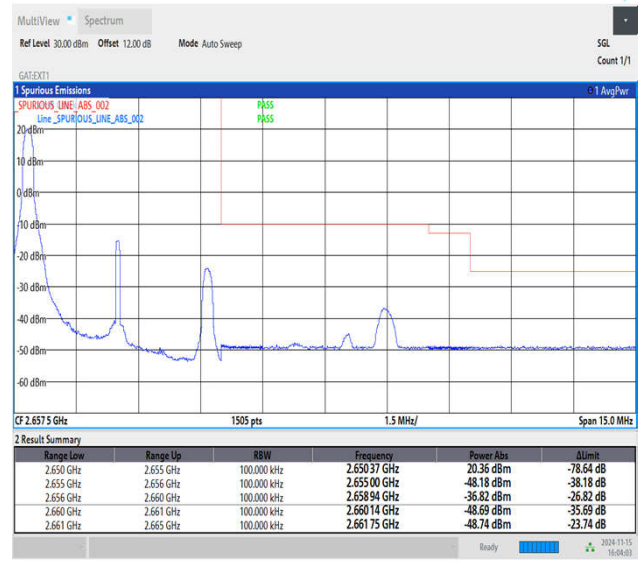


Band41_5MHz_64QAM_41215_1RB#0

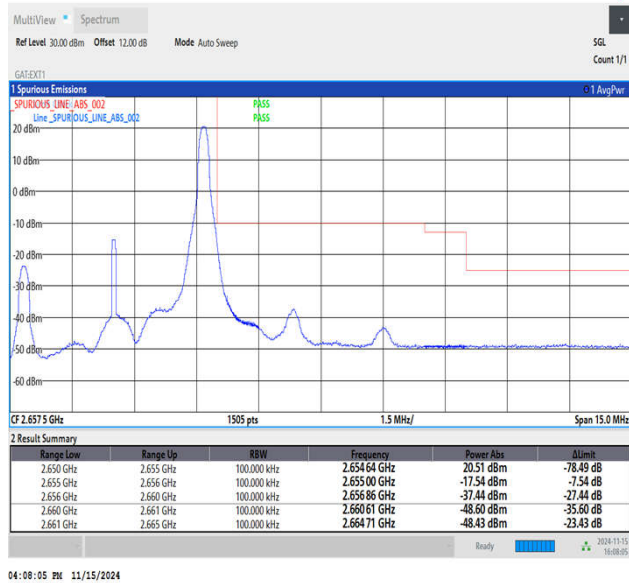


Band41_5MHz_64QAM_41215_1RB#24

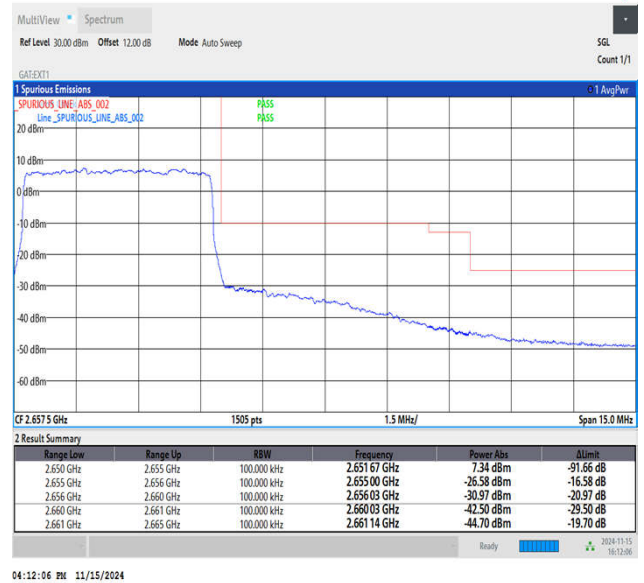


Band41_5MHz_64QAM_41215_25RB#0

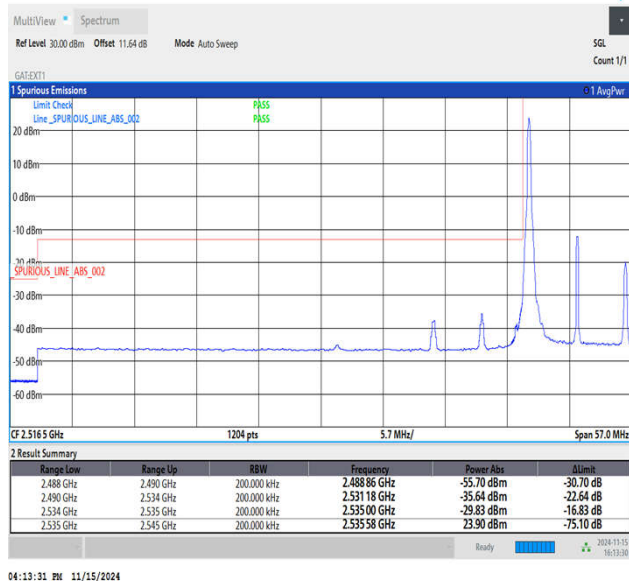


Band41_10MHz_QPSK_40090_1RB#0

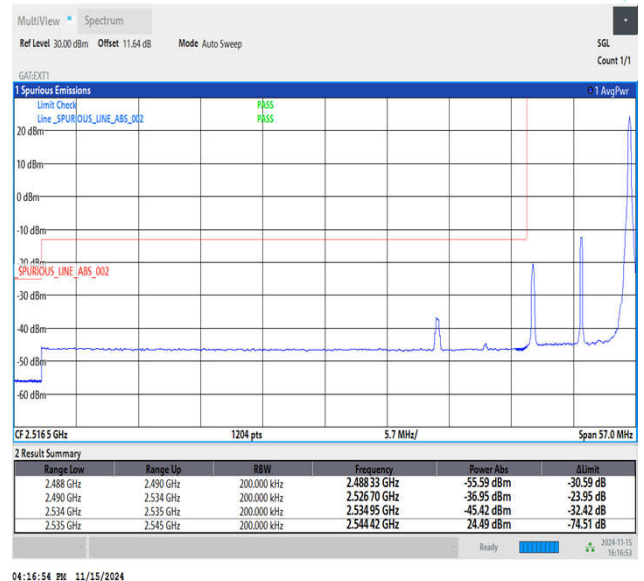

Band41_10MHz_QPSK_40090_1RB#49

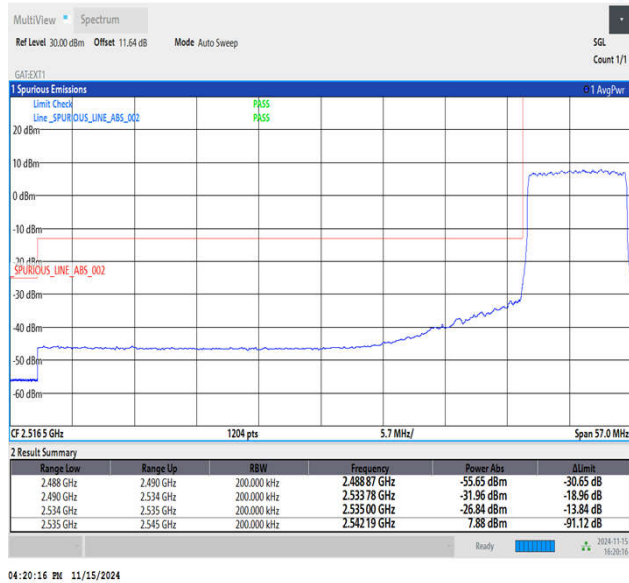


Band41_10MHz_QPSK_40090_50RB#0

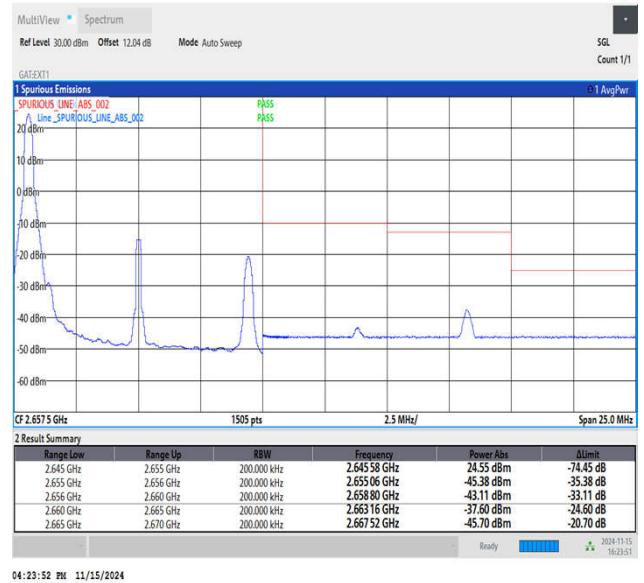


Band41_10MHz_QPSK_41190_1RB#0




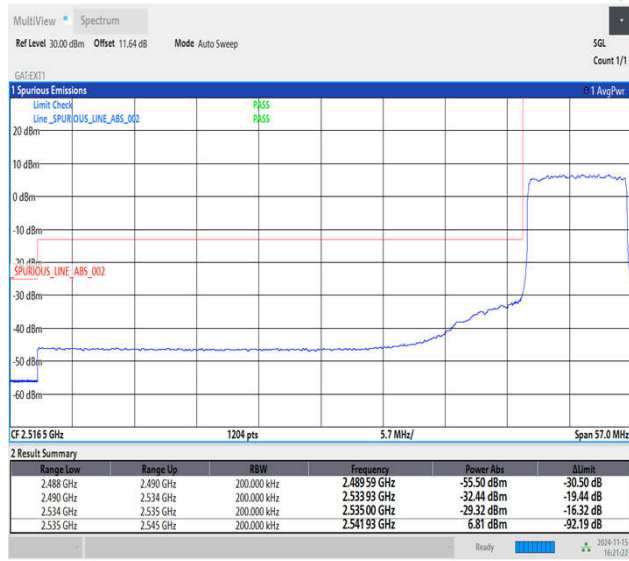


Band41_10MHz_16QAM_40090_50RB#0

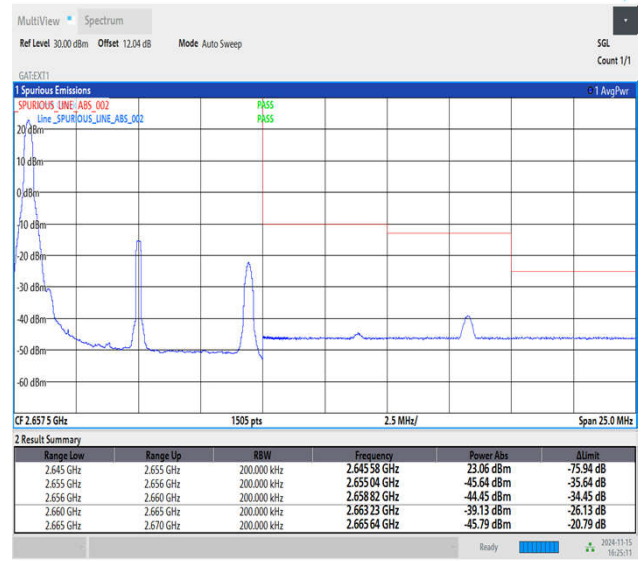


Band41_10MHz_16QAM_41190_1RB#0

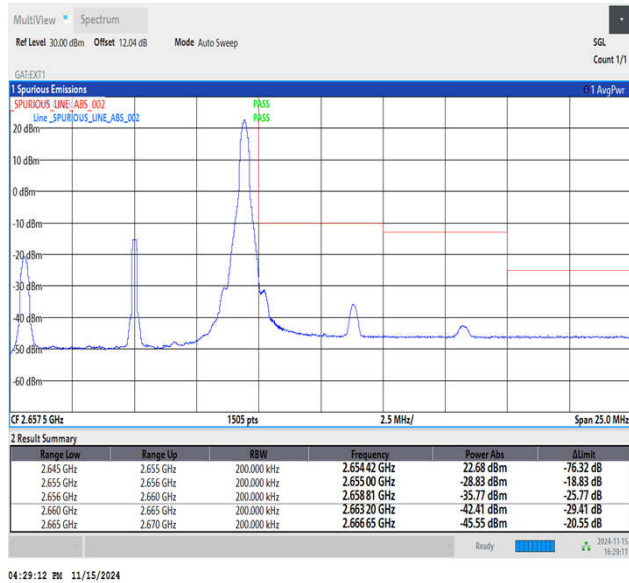


Band41_10MHz_16QAM_41190_1RB#49

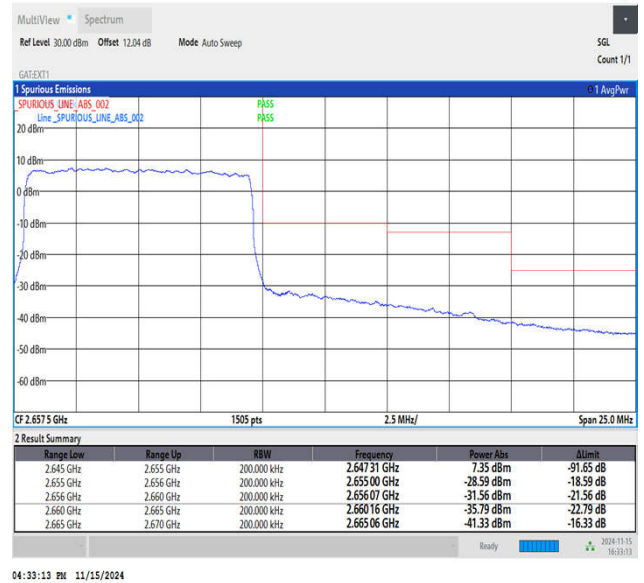


Band41_10MHz_16QAM_41190_50RB#0

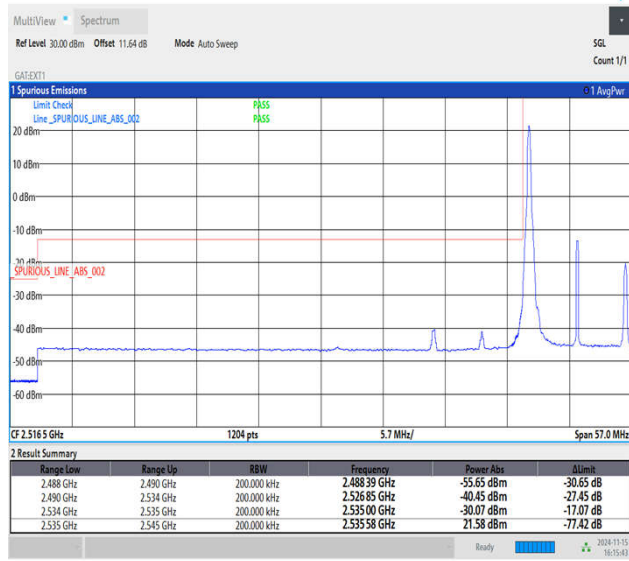


Band41_10MHz_64QAM_40090_1RB#0

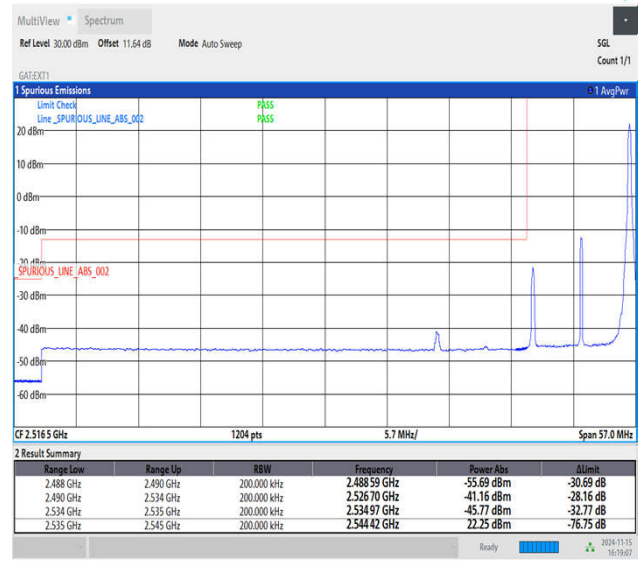

Band41_10MHz_64QAM_40090_1RB#49

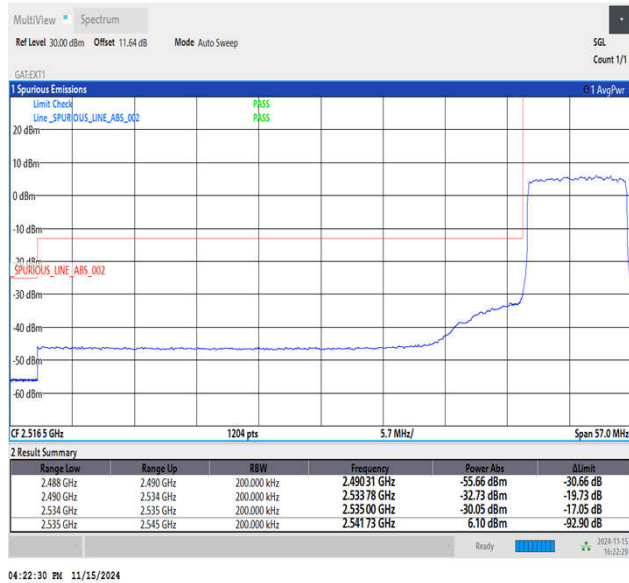


Band41_10MHz_64QAM_40090_50RB#0

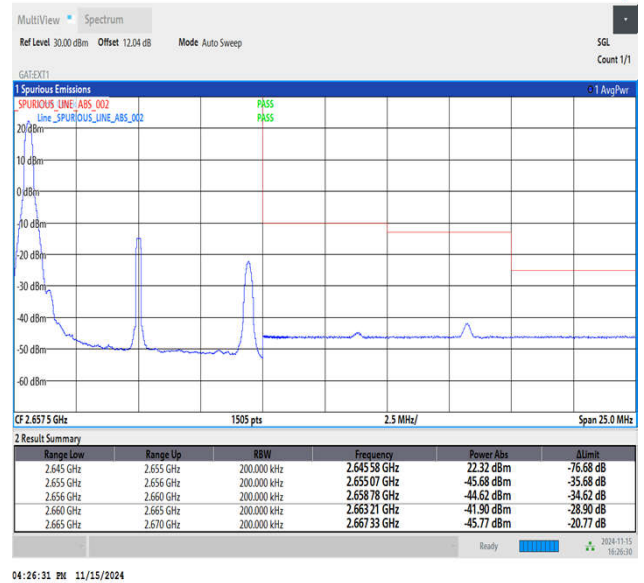

Band41_10MHz_64QAM_41190_1RB#0



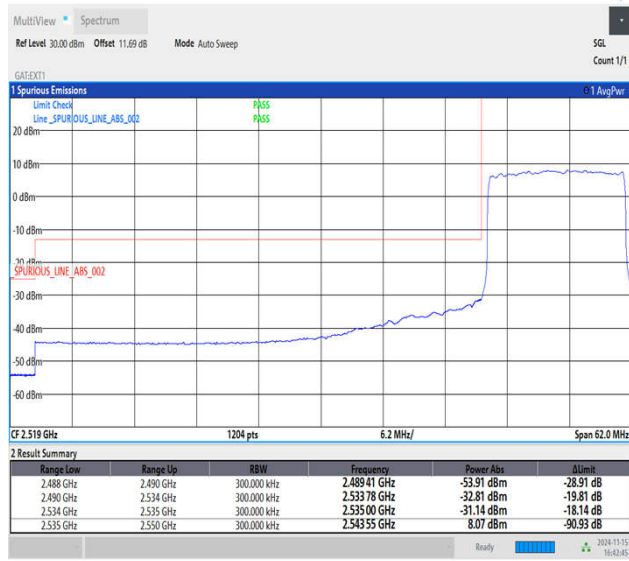


04:42:46 PM 11/15/2024

Band41_15MHz_QPSK_40115_75RB#0




04:46:22 PM 11/15/2024

Band41_15MHz_QPSK_41165_1RB#0

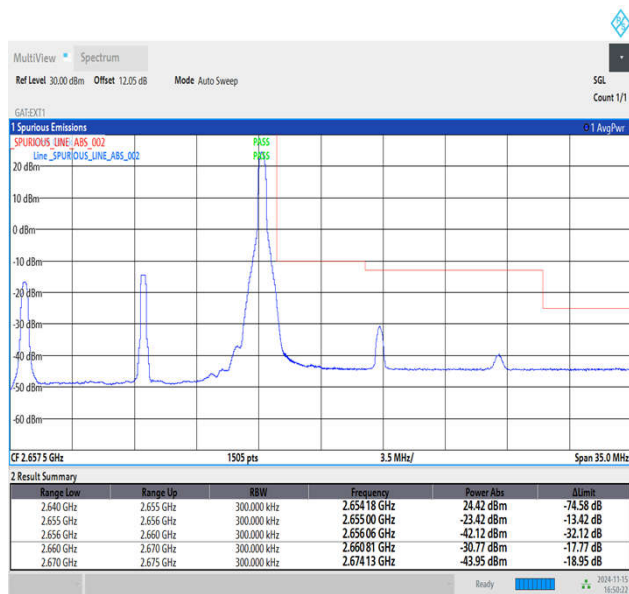


04:50:23 PM 11/15/2024

Band41_15MHz_QPSK_41165_1RB#74

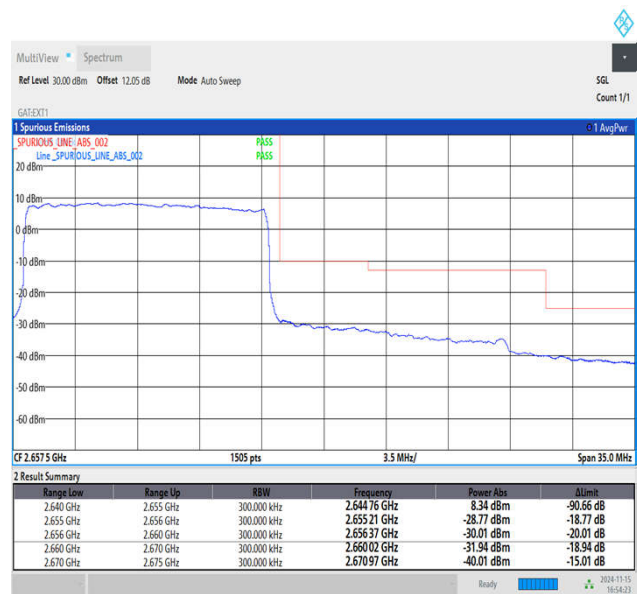


04:54:24 PM 11/15/2024


Band41_15MHz_QPSK_41165_75RB#0

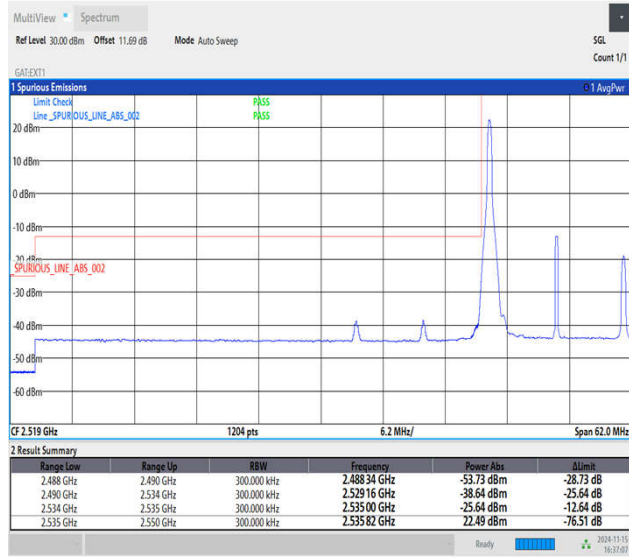


Band41_15MHz_16QAM_40115_1RB#0

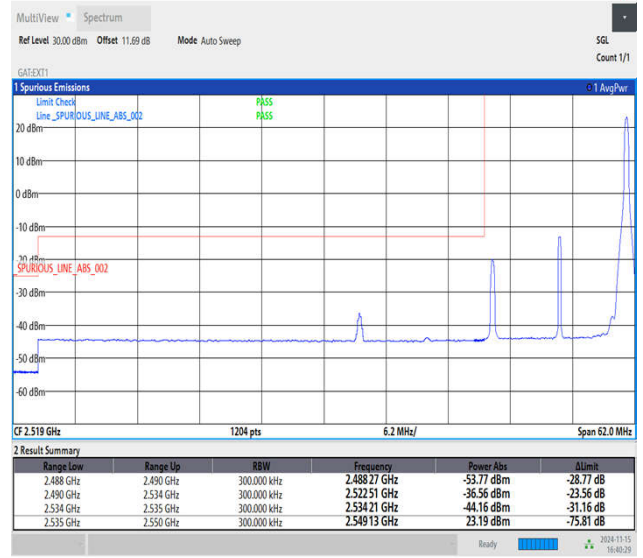


Band41_15MHz_16QAM_40115_1RB#74

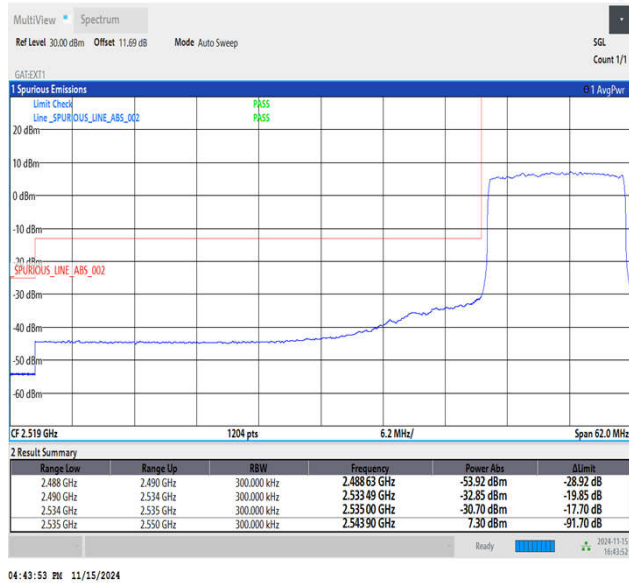

Band41_15MHz_16QAM_40115_75RB#0

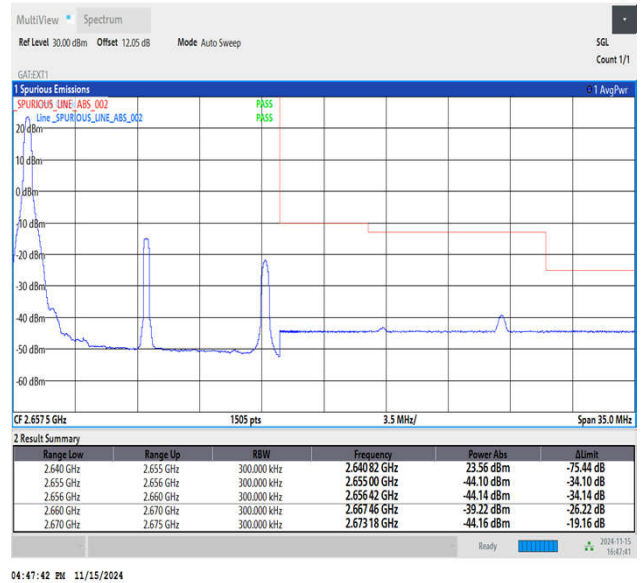


Band41_15MHz_16QAM_41165_1RB#0

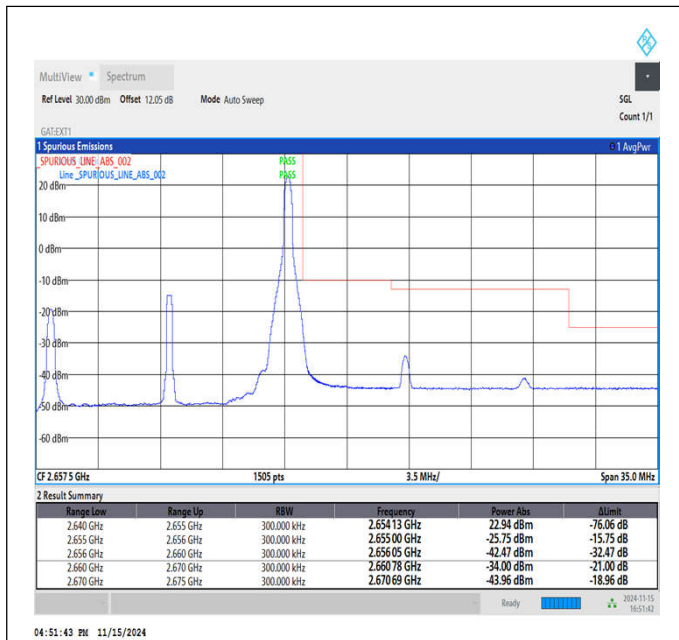


Band41_15MHz_16QAM_41165_1RB#74




Band41_15MHz_16QAM_41165_75RB#0

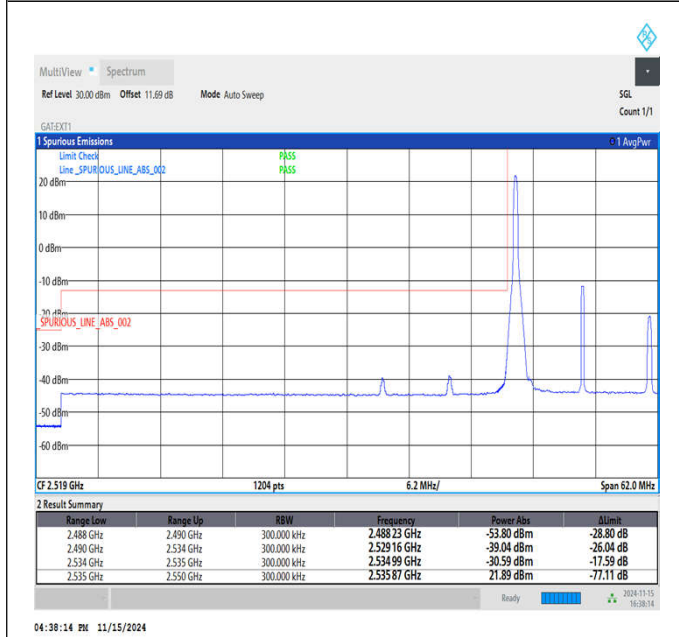


Band41_15MHz_64QAM_40115_1RB#0

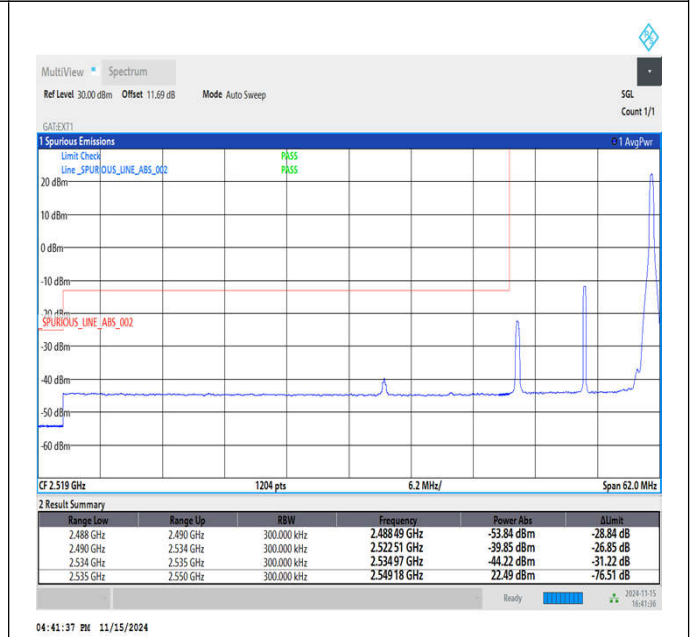


Band41_15MHz_64QAM_40115_1RB#74

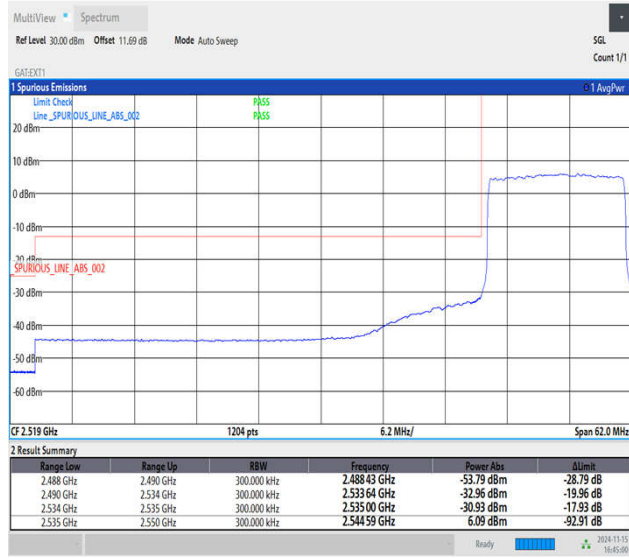


Band41_15MHz_64QAM_40115_75RB#0

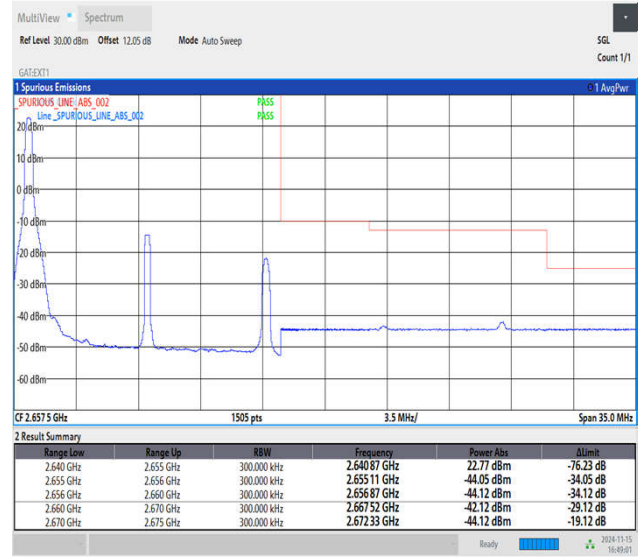

Band41_15MHz_64QAM_41165_1RB#0

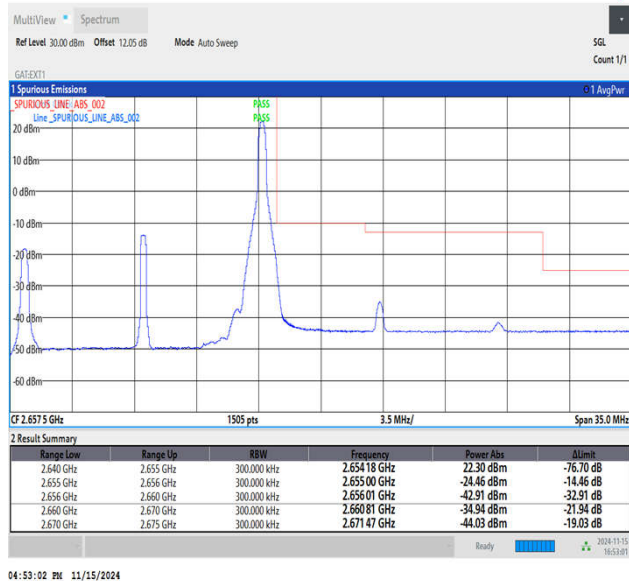

Band41_15MHz_64QAM_41165_1RB#74

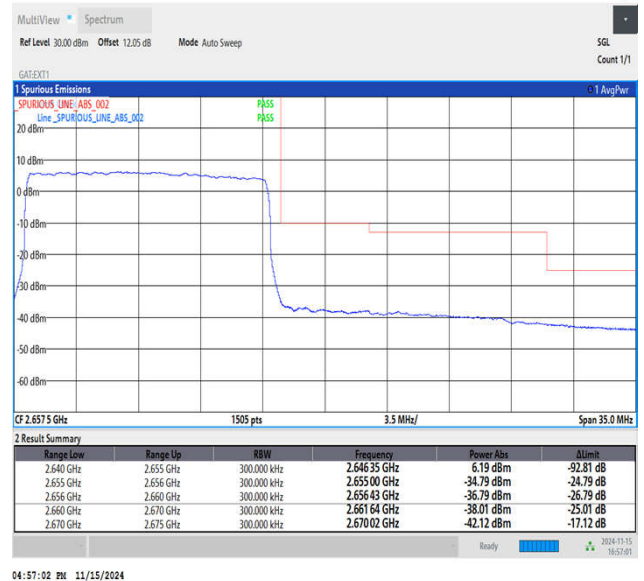

Band41_15MHz_64QAM_41165_75RB#0