



11N20SISO_Ant1_5500




11N20SISO_Ant1_5580




11N20SISO_Ant1_5700



11N20SISO_Ant1_5745

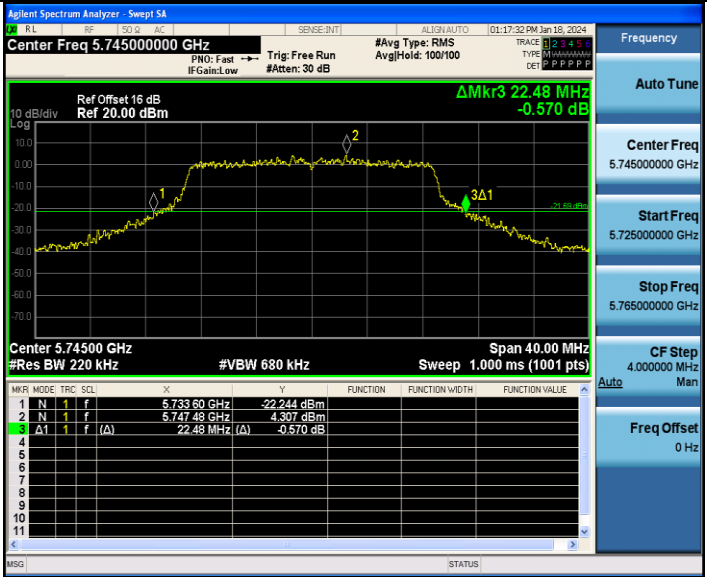


11N20SISO_Ant1_5785

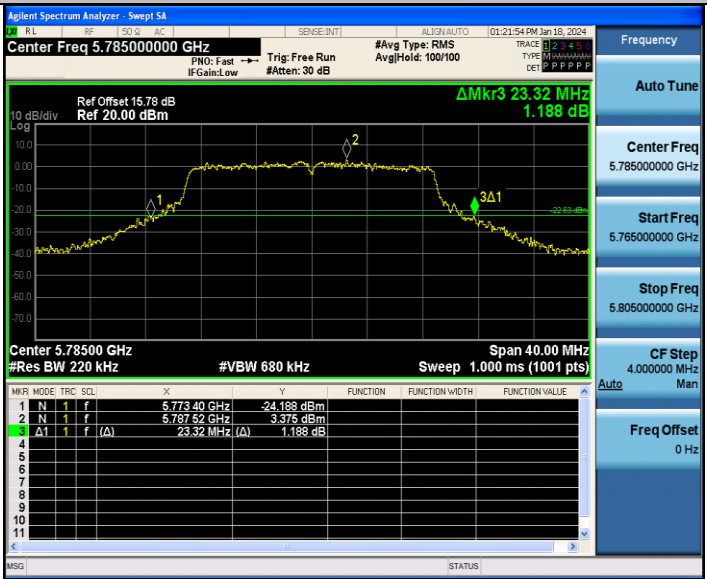


11N20SISO_Ant1_5825



11N40SISO_Ant1_5190

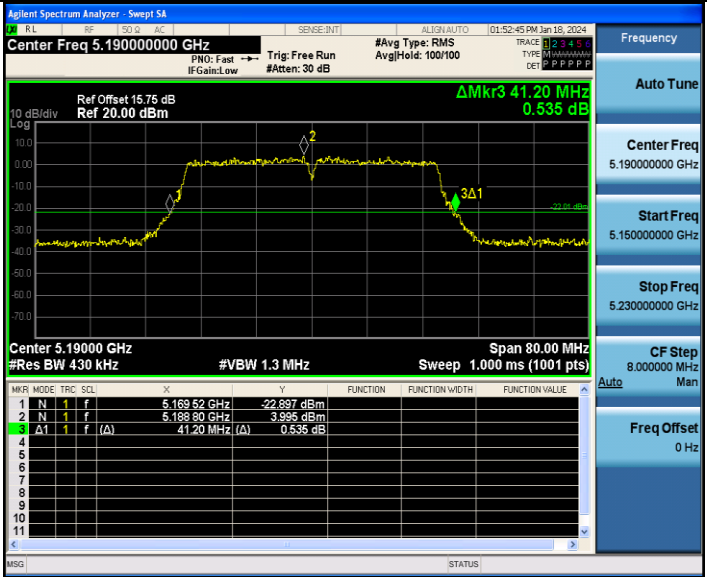

11N40SISO_Ant1_5230

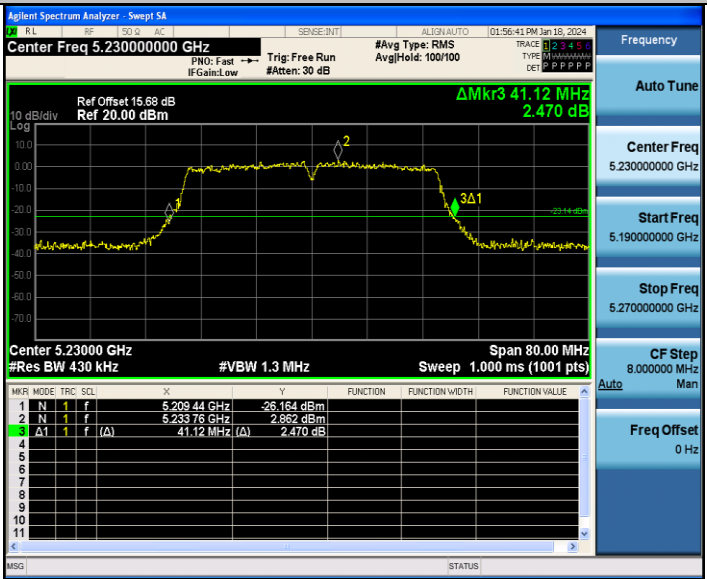


11N40SISO_Ant1_5270



11N40SISO_Ant1_5310



11N40SISO_Ant1_5510

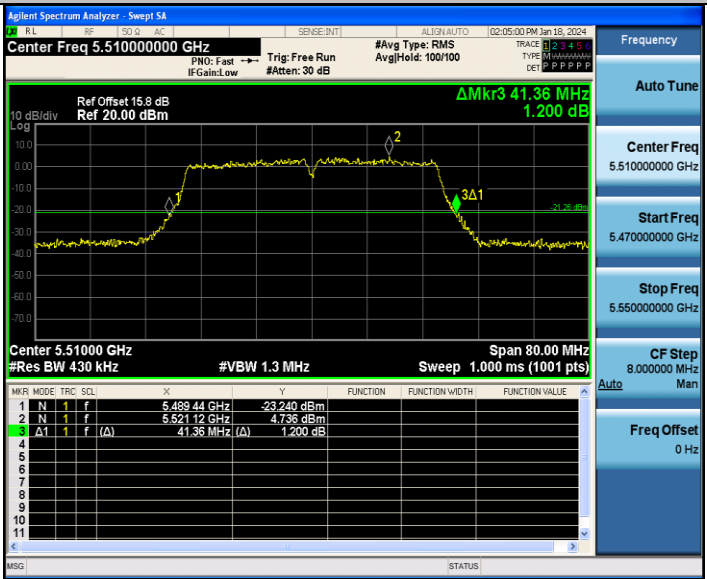


11N40SISO_Ant1_5590



11N40SISO Ant1 5670




11N40SISO Ant1 5755

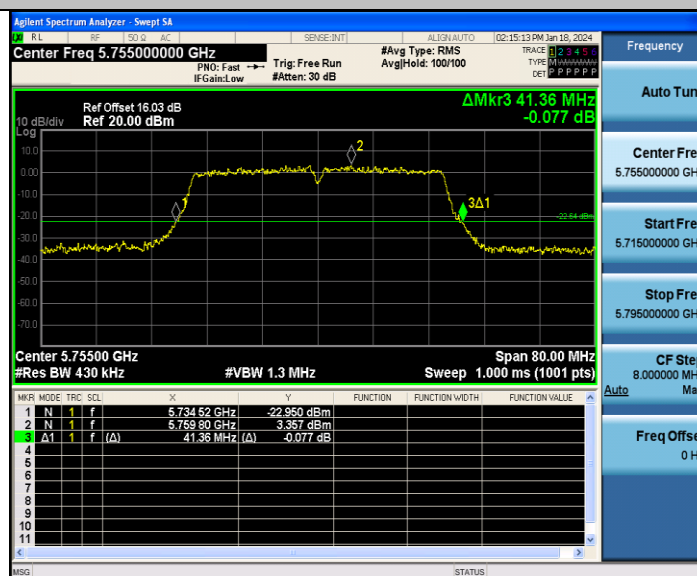


11N40SISO Ant1 5795




11AC20SISO_Ant1_5180

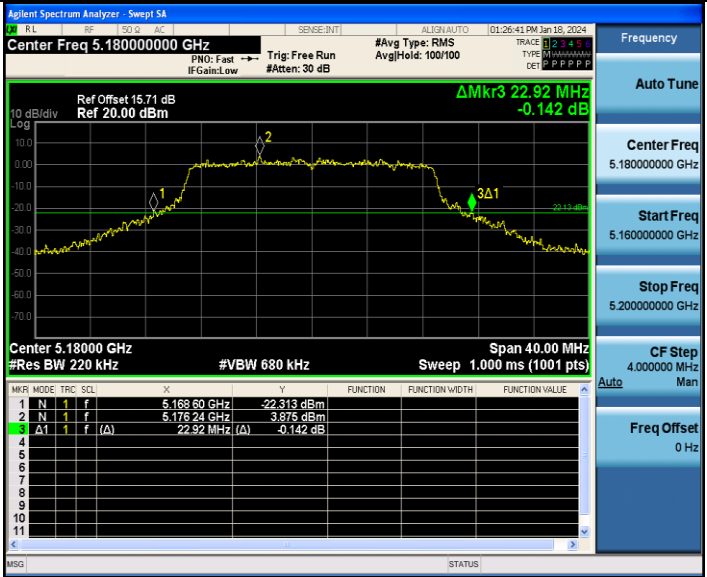

11AC20SISO_Ant1_5220

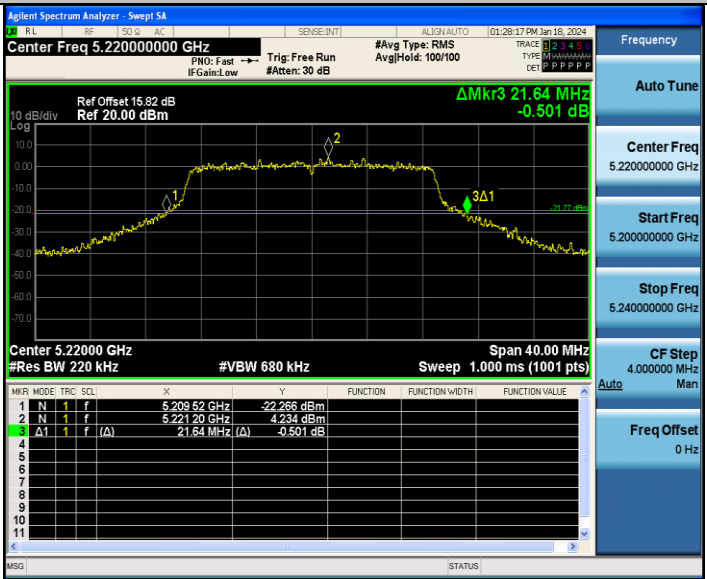

11AC20SISO_Ant1_5240

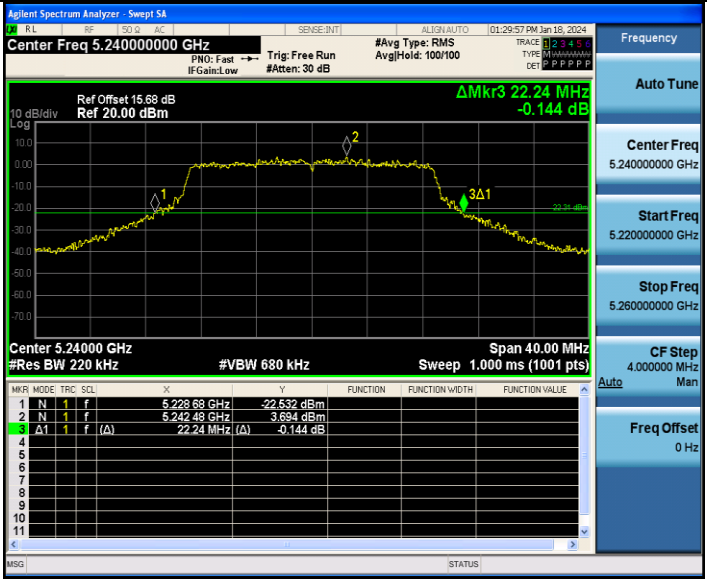

11AC20SISO_Ant1_5260



11AC20SISO_Ant1_5300




11AC20SISO_Ant1_5320




11AC20SISO_Ant1_5500



11AC20SISO_Ant1_5580

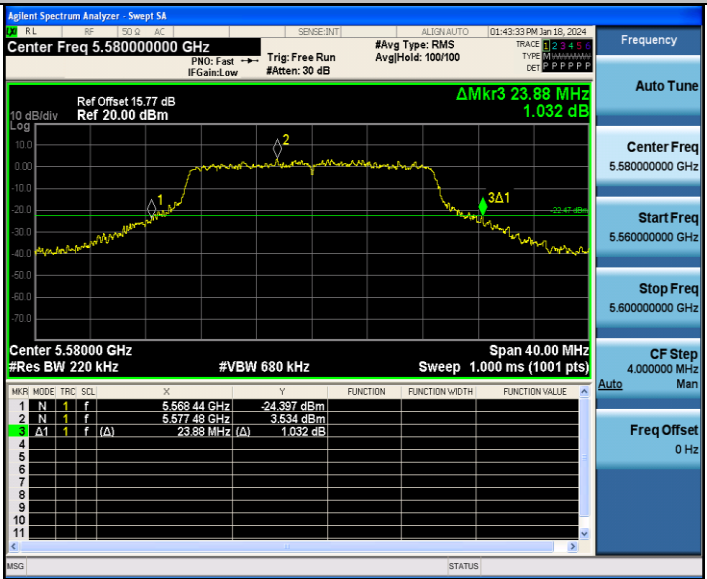


11AC20SISO_Ant1_5700

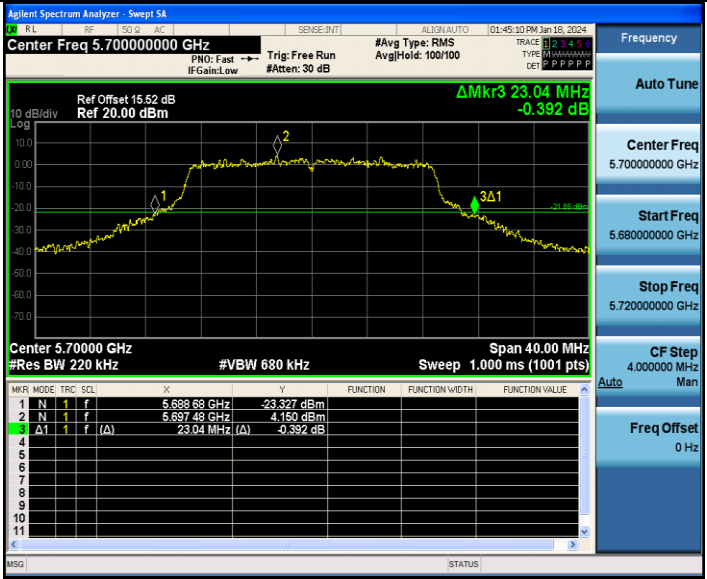

11AC20SISO_Ant1_5745




11AC20SISO_Ant1_5785

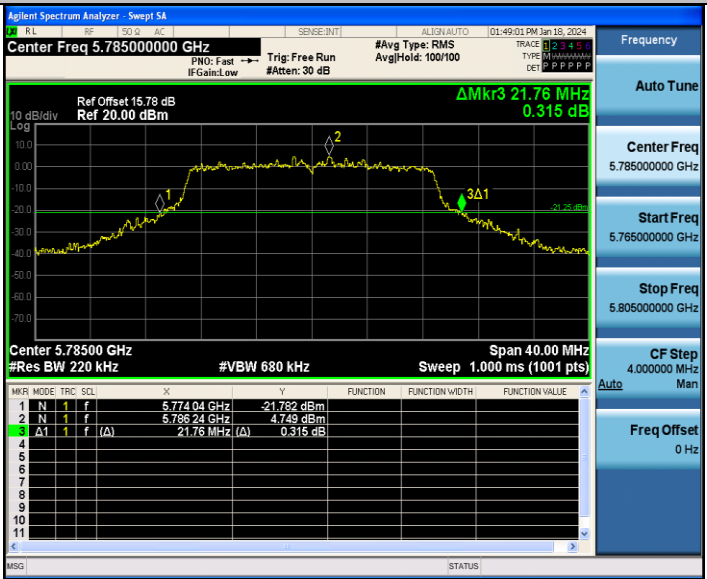


11AC20SISO_Ant1_5825



11AC40SISO_Ant1_5190

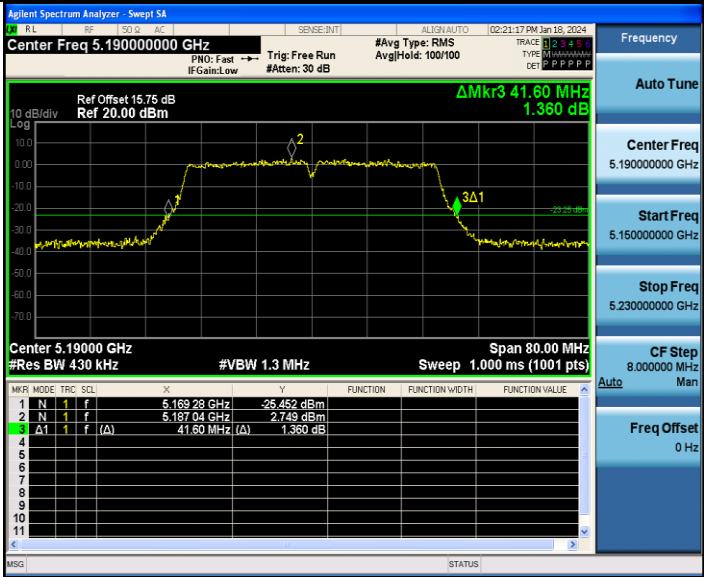


11AC40SISO_Ant1_5230

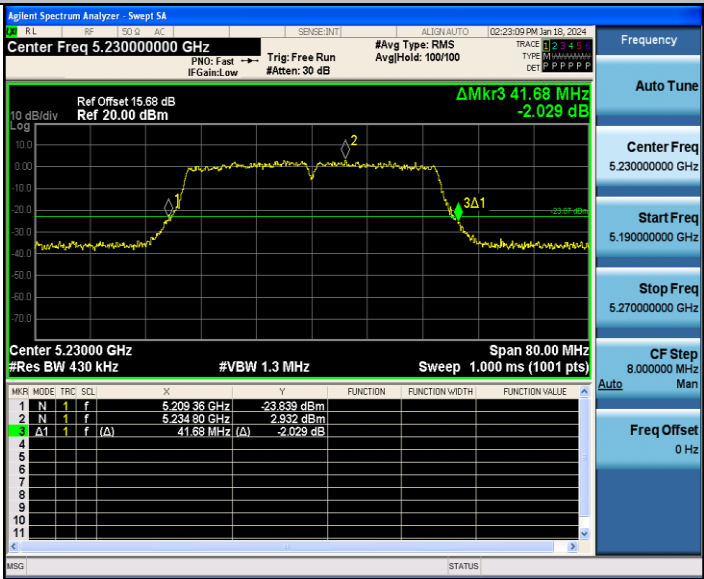

11AC40SISO_Ant1_5270



11AC40SISO_Ant1_5310

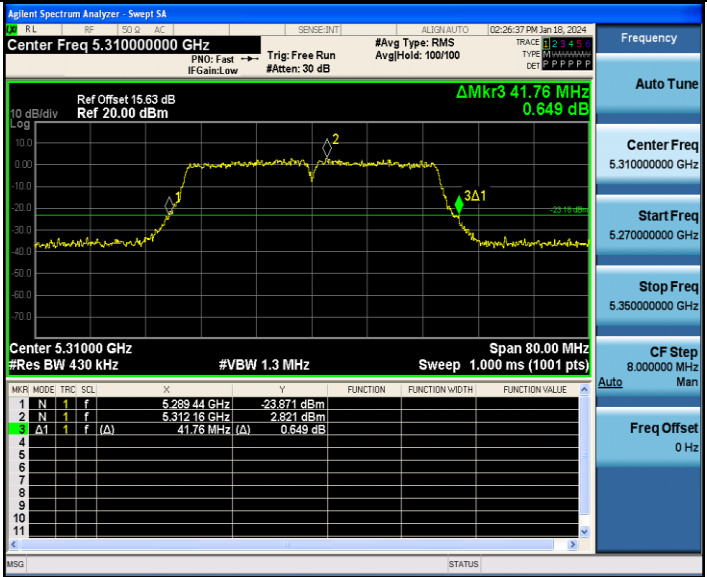

11AC40SISO_Ant1_5510




11AC40SISO_Ant1_5590



11AC40SISO_Ant1_5670




11AC40SISO_Ant1_5755

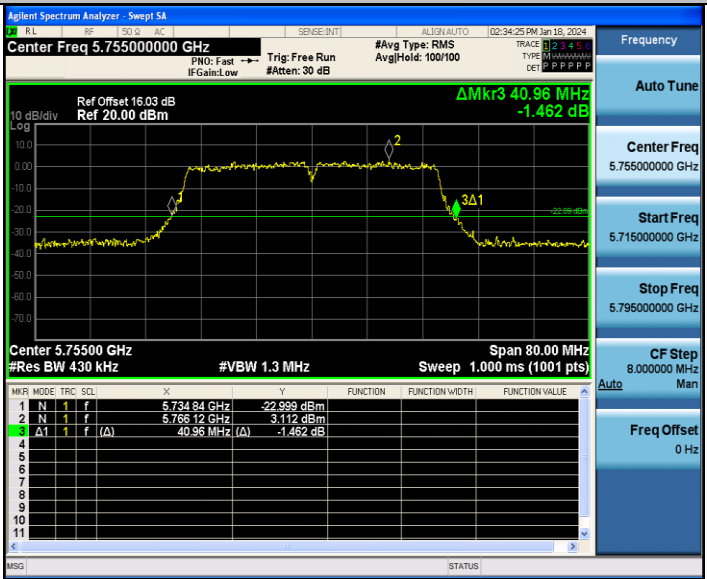


11AC40SISO_Ant1_5795




11AC80SISO_Ant1_5210

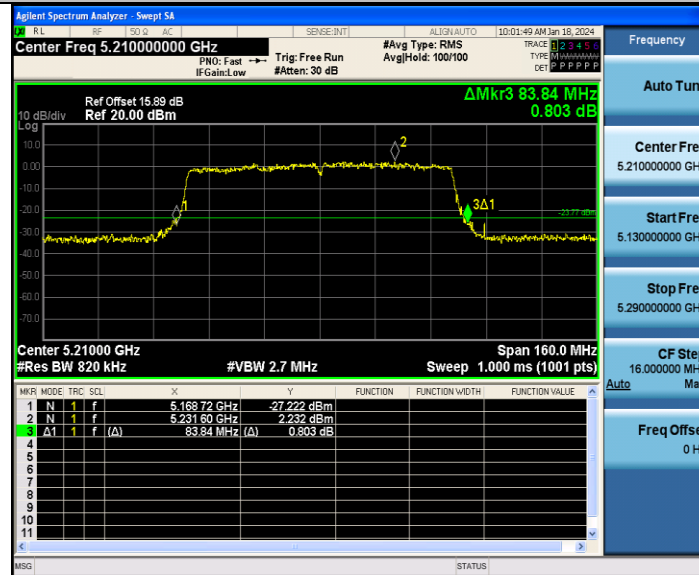


11AC80SISO_Ant1_5290

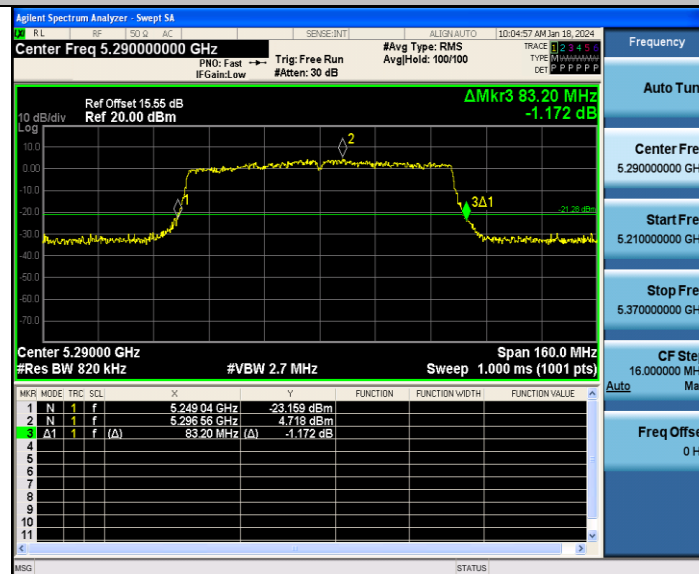


11AC80SISO_Ant1_5530

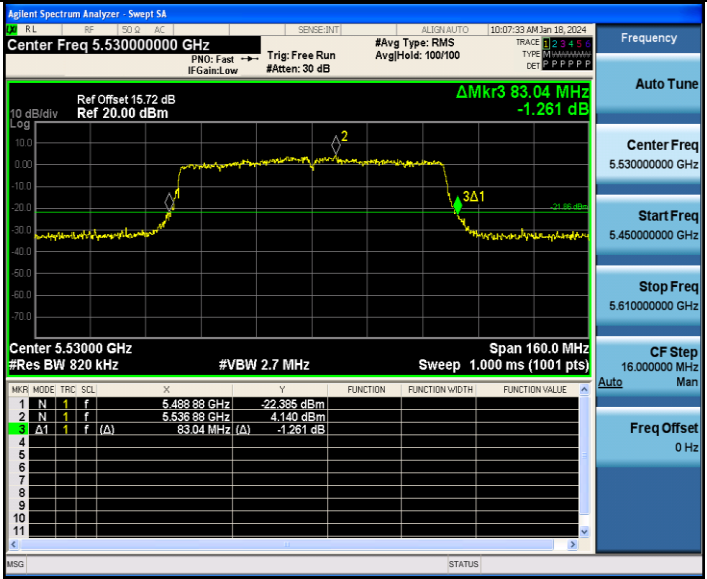

11AC80SISO_Ant1_5610

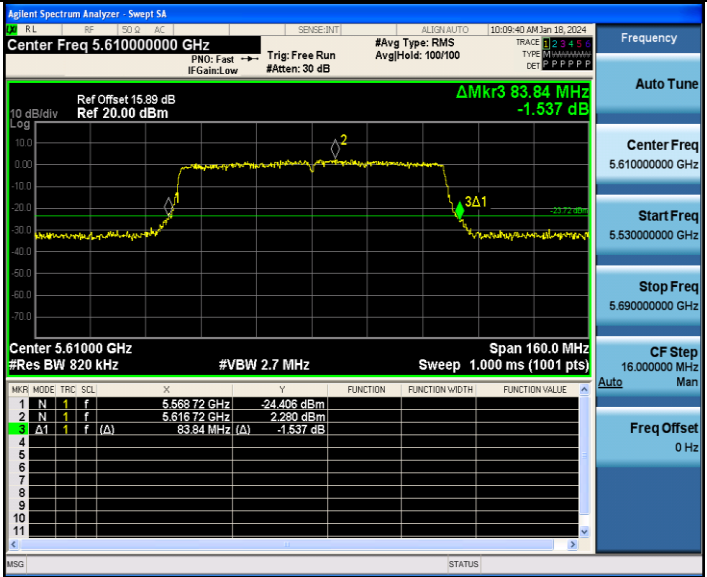

11AC80SISO_Ant1_5775

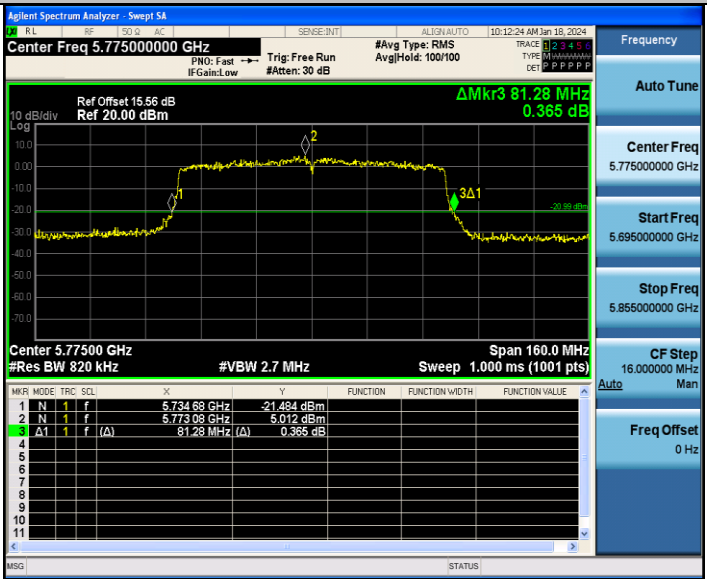


Occupied channel bandwidth :

TestMode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.888	5171.5193	5188.4073	N/A	Pass
		5220	16.843	5211.5786	5228.4216	N/A	Pass
		5240	16.839	5231.5310	5248.3700	N/A	Pass
		5260	16.937	5251.5239	5268.4609	N/A	Pass
		5300	16.844	5291.5472	5308.3912	N/A	Pass
		5320	16.908	5311.5361	5328.4441	N/A	Pass
		5500	16.879	5491.5407	5508.4197	N/A	Pass
		5580	16.775	5571.6016	5588.3766	N/A	Pass
		5700	16.850	5691.5575	5708.4075	N/A	Pass
		5745	16.889	5736.5174	5753.4064	N/A	Pass
		5785	16.829	5776.5347	5793.3637	N/A	Pass
		5825	16.798	5816.6154	5833.4134	N/A	Pass
11N20SISO	Ant1	5180	18.059	5170.9580	5189.0170	N/A	Pass
		5220	18.027	5211.0255	5229.0525	N/A	Pass
		5240	18.014	5230.9924	5249.0064	N/A	Pass
		5260	18.089	5250.9891	5269.0781	N/A	Pass
		5300	18.023	5290.9820	5309.0050	N/A	Pass
		5320	18.070	5311.0007	5329.0707	N/A	Pass
		5500	18.080	5490.9865	5509.0665	N/A	Pass
		5580	18.003	5571.0331	5589.0361	N/A	Pass
		5700	18.044	5690.9985	5709.0425	N/A	Pass
		5745	18.054	5735.9849	5754.0389	N/A	Pass
		5785	18.006	5775.9837	5793.9897	N/A	Pass
		5825	18.004	5816.0229	5834.0269	N/A	Pass
11N40SISO	Ant1	5190	36.529	5171.7797	5208.3087	N/A	Pass
		5230	36.371	5211.8841	5248.2551	N/A	Pass
		5270	36.478	5251.9051	5288.3831	N/A	Pass
		5310	36.476	5291.8225	5328.2985	N/A	Pass
		5510	36.510	5491.8889	5528.3989	N/A	Pass
		5590	36.447	5571.8459	5608.2929	N/A	Pass
		5670	36.466	5651.8782	5688.3442	N/A	Pass
		5755	36.483	5736.8443	5773.3273	N/A	Pass
		5795	36.506	5776.7853	5813.2913	N/A	Pass
11AC20SISO	Ant1	5180	18.052	5170.9549	5189.0069	N/A	Pass
		5220	17.993	5211.0367	5229.0297	N/A	Pass
		5240	18.014	5230.9683	5248.9823	N/A	Pass
		5260	18.098	5250.9804	5269.0784	N/A	Pass
		5300	18.030	5290.9846	5309.0146	N/A	Pass
		5320	18.092	5310.9824	5329.0744	N/A	Pass
		5500	18.077	5491.0001	5509.0771	N/A	Pass
		5580	18.010	5571.0197	5589.0297	N/A	Pass
		5700	18.038	5690.9995	5709.0375	N/A	Pass
		5745	18.038	5735.9943	5754.0323	N/A	Pass
		5785	18.034	5775.9661	5794.0001	N/A	Pass
		5825	18.025	5816.0445	5834.0695	N/A	Pass
11AC40SISO	Ant1	5190	36.464	5171.8046	5208.2686	N/A	Pass
		5230	36.322	5211.8790	5248.2010	N/A	Pass


		5270	36.473	5251.8930	5288.3660	N/A	Pass
		5310	36.467	5291.8153	5328.2823	N/A	Pass
		5510	36.452	5491.8846	5528.3366	N/A	Pass
		5590	36.399	5571.8354	5608.2344	N/A	Pass
		5670	36.372	5651.8960	5688.2680	N/A	Pass
		5755	36.472	5736.8427	5773.3147	N/A	Pass
		5795	36.470	5776.7654	5813.2354	N/A	Pass
11AC80SISO	Ant1	5210	75.769	5172.2423	5248.0113	N/A	Pass
		5290	75.674	5252.4275	5328.1015	N/A	Pass
		5530	75.755	5492.2726	5568.0276	N/A	Pass
		5610	75.747	5572.2781	5648.0251	N/A	Pass
		5775	75.699	5737.2197	5812.9187	N/A	Pass

Note: We have evaluated SISO, MIMO mode, shown in the report is the worst data.

11A_Ant1_5180

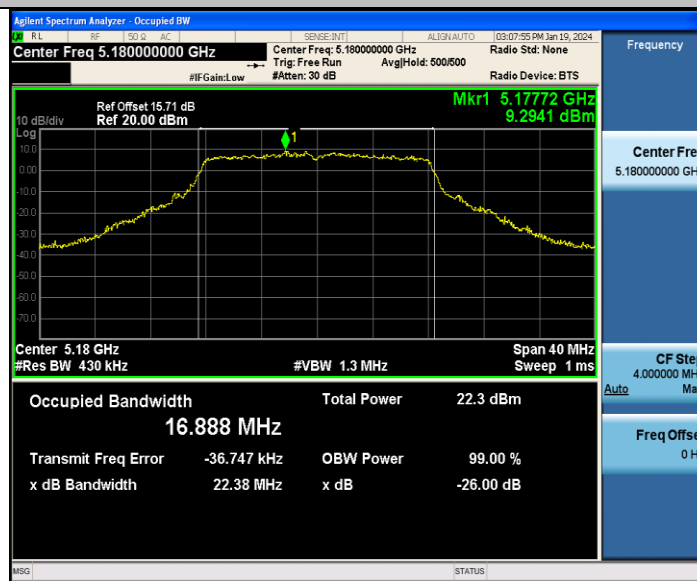

11A_Ant1_5220

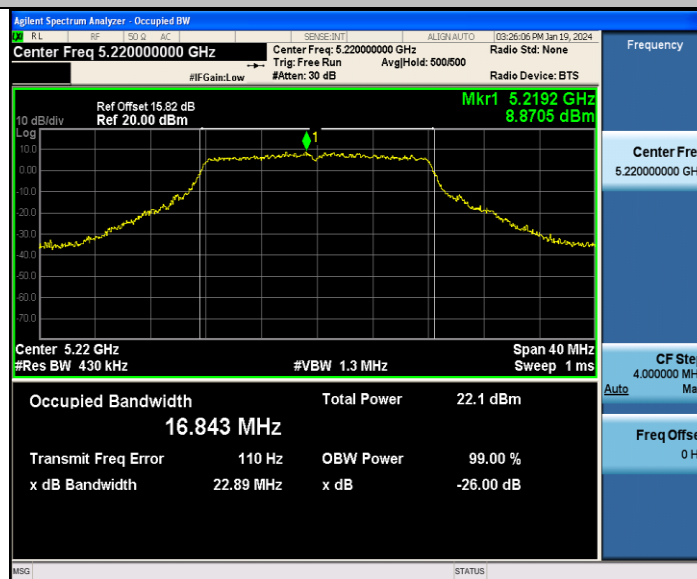

11A_Ant1_5240




11A_Ant1_5260




11A_Ant1_5300




11A_Ant1_5320

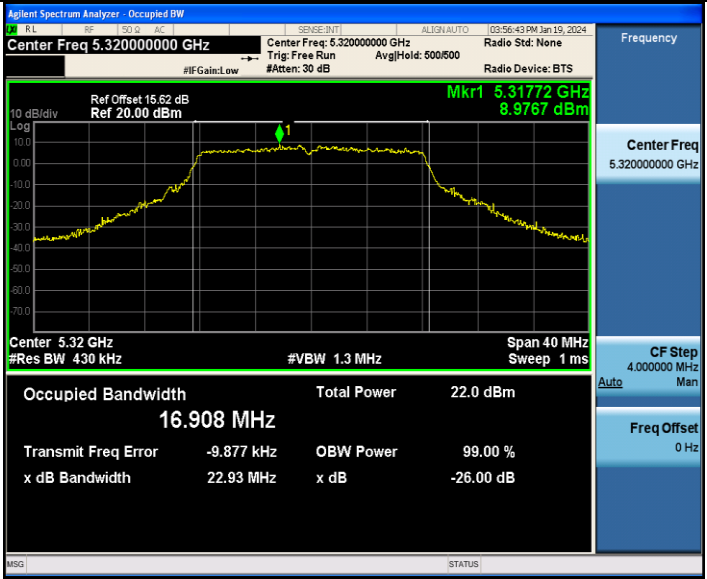


11A_Ant1_5500

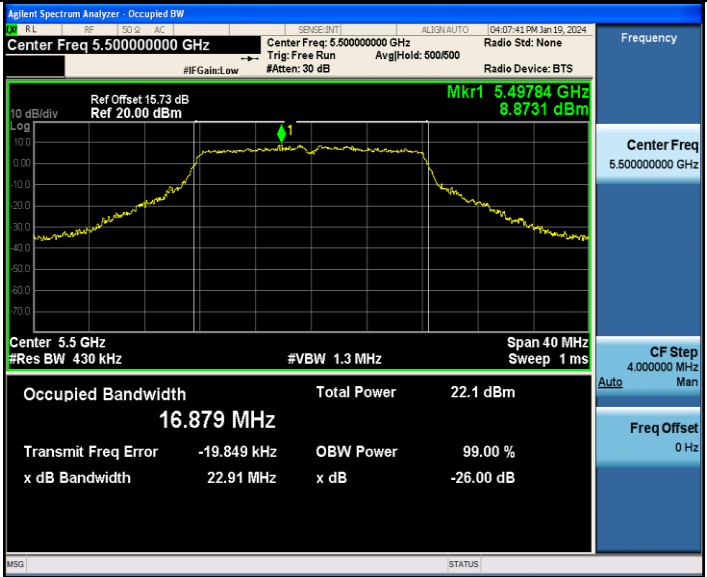


11A_Ant1_5580

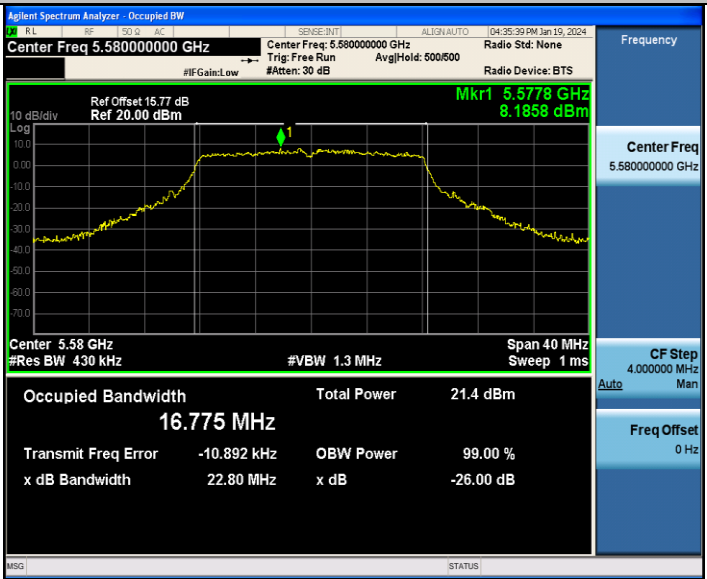


11A_Ant1_5700

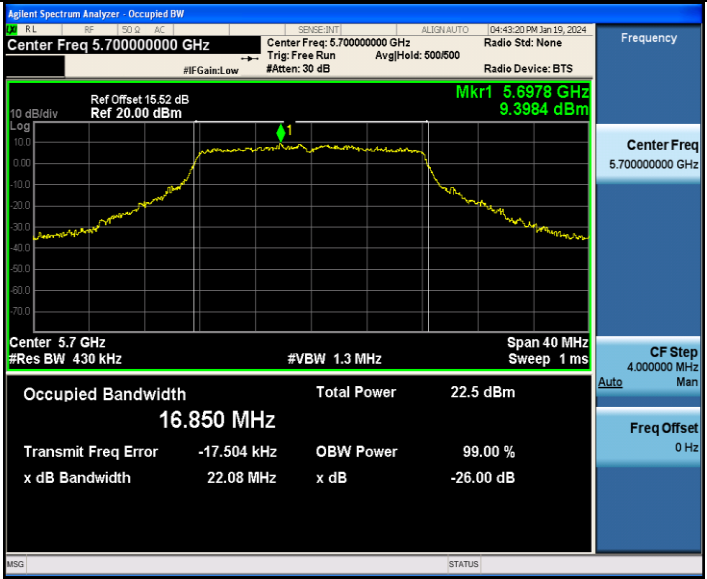

11A_Ant1_5745

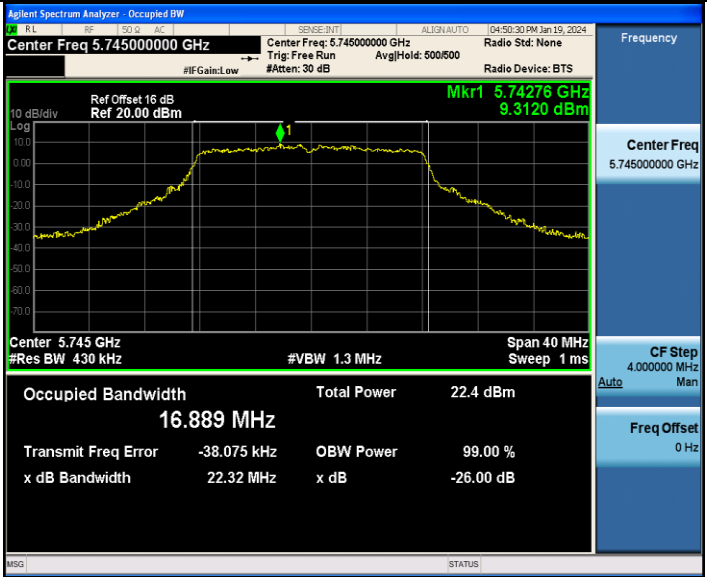

11A_Ant1_5785

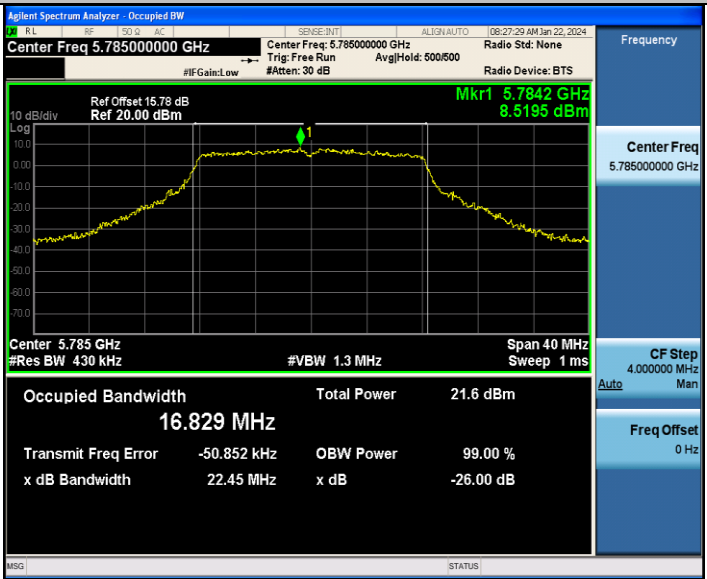

11A_Ant1_5825



11N20SISO_Ant1_5180



11N20SISO_Ant1_5220



11N20SISO_Ant1_5240



11N20SISO_Ant1_5260



11N20SISO_Ant1_5300



11N20SISO_Ant1_5320