




Test report No. : 4790038917B-US-R1-V0
Page : 65 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

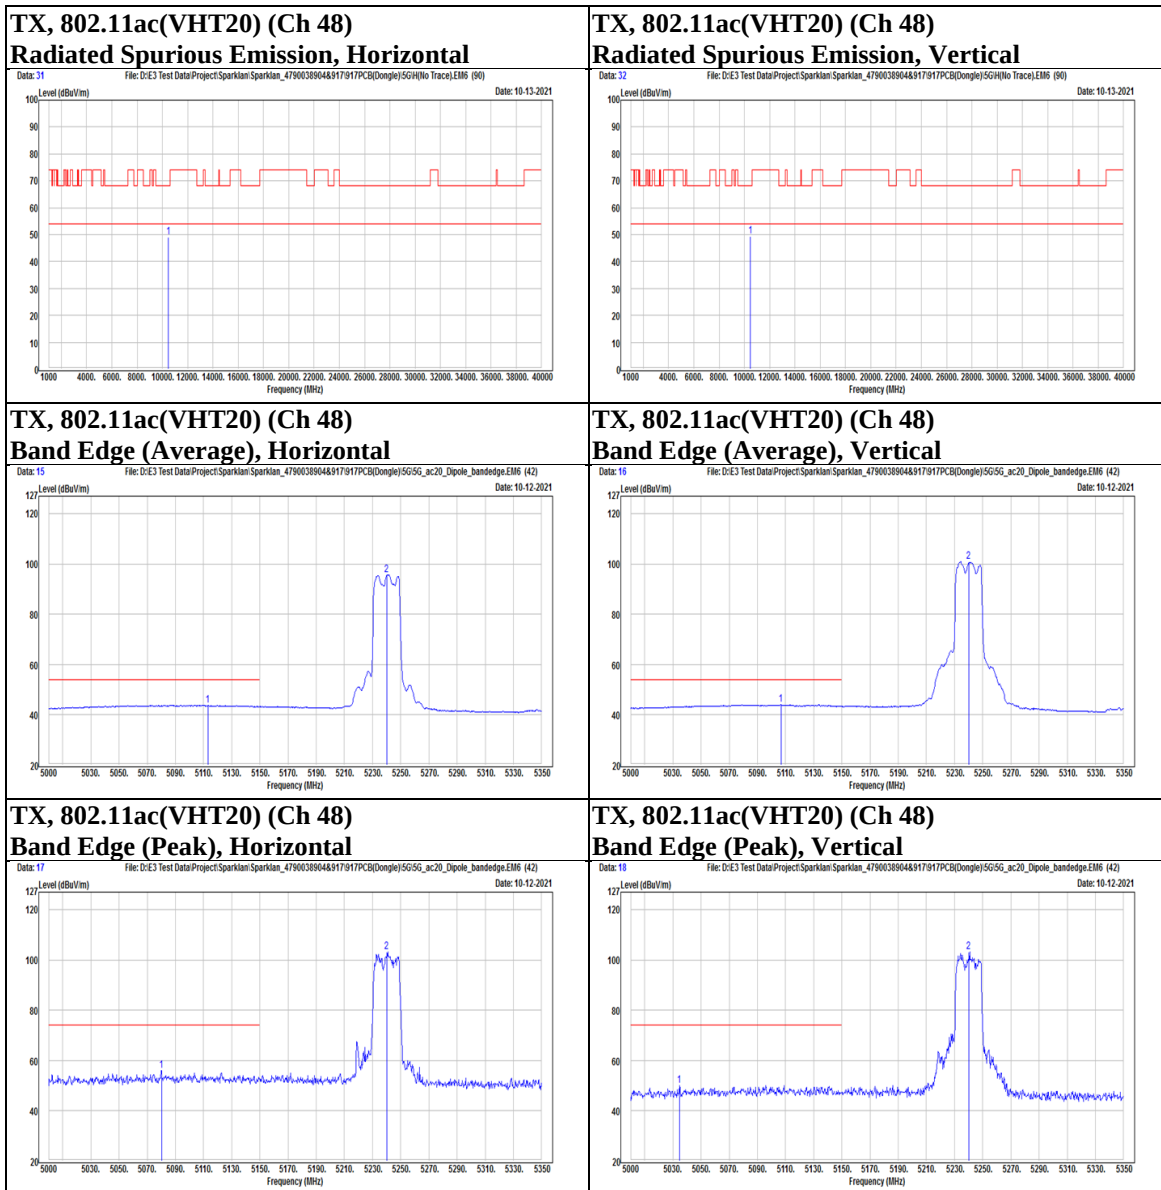

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 66 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT20)	Channel	52
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5260	90.33	13.24	103.57	N/A	N/A	PK
	@	5260	82.28	13.24	95.52	N/A	N/A	AVG
		5366.7	29.06	13.31	42.37	54	-11.63	AVG
		5453.1	40.79	13.68	54.47	74	-19.53	PK
		10520	31.67	17.73	49.4	68.2	-18.8	PK
Vertical	@	5260	95.48	13.24	108.72	N/A	N/A	PK
	@	5260	87.4	13.24	100.64	N/A	N/A	AVG
		5366.7	30.12	13.31	43.43	54	-10.57	AVG
		5393.4	40.96	13.4	54.36	74	-19.64	PK
		10520	31.87	17.73	49.6	68.2	-18.6	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

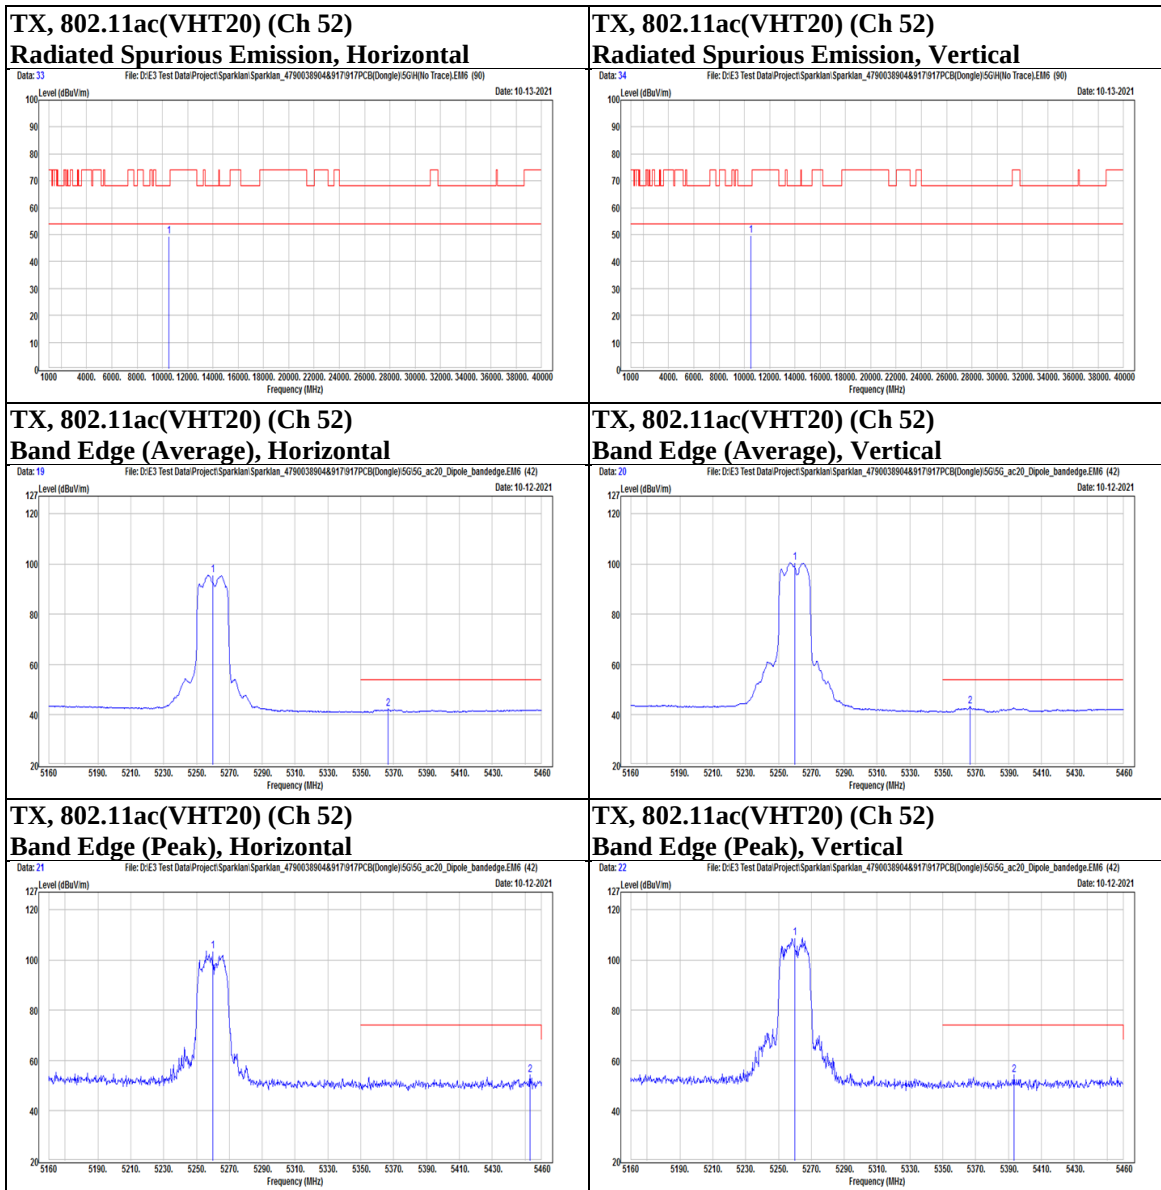



Test report No. : 4790038917B-US-R1-V0
Page : 68 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT20)	Channel	60
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5300	90.82	13.21	104.03	N/A	N/A	PK
	@	5300	82.19	13.21	95.4	N/A	N/A	AVG
		5380.2	29.73	13.35	43.08	54	-10.92	AVG
		5452.8	39.8	13.68	53.48	74	-20.52	PK
		10600	31.22	17.73	48.95	68.2	-19.25	PK
Vertical	@	5300	94.4	13.21	107.61	N/A	N/A	PK
	@	5300	86.05	13.21	99.26	N/A	N/A	AVG
		5379.9	30.87	13.35	44.22	54	-9.78	AVG
		5415.6	40.45	13.49	53.94	74	-20.06	PK
		10600	31.87	17.73	49.6	68.2	-18.6	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

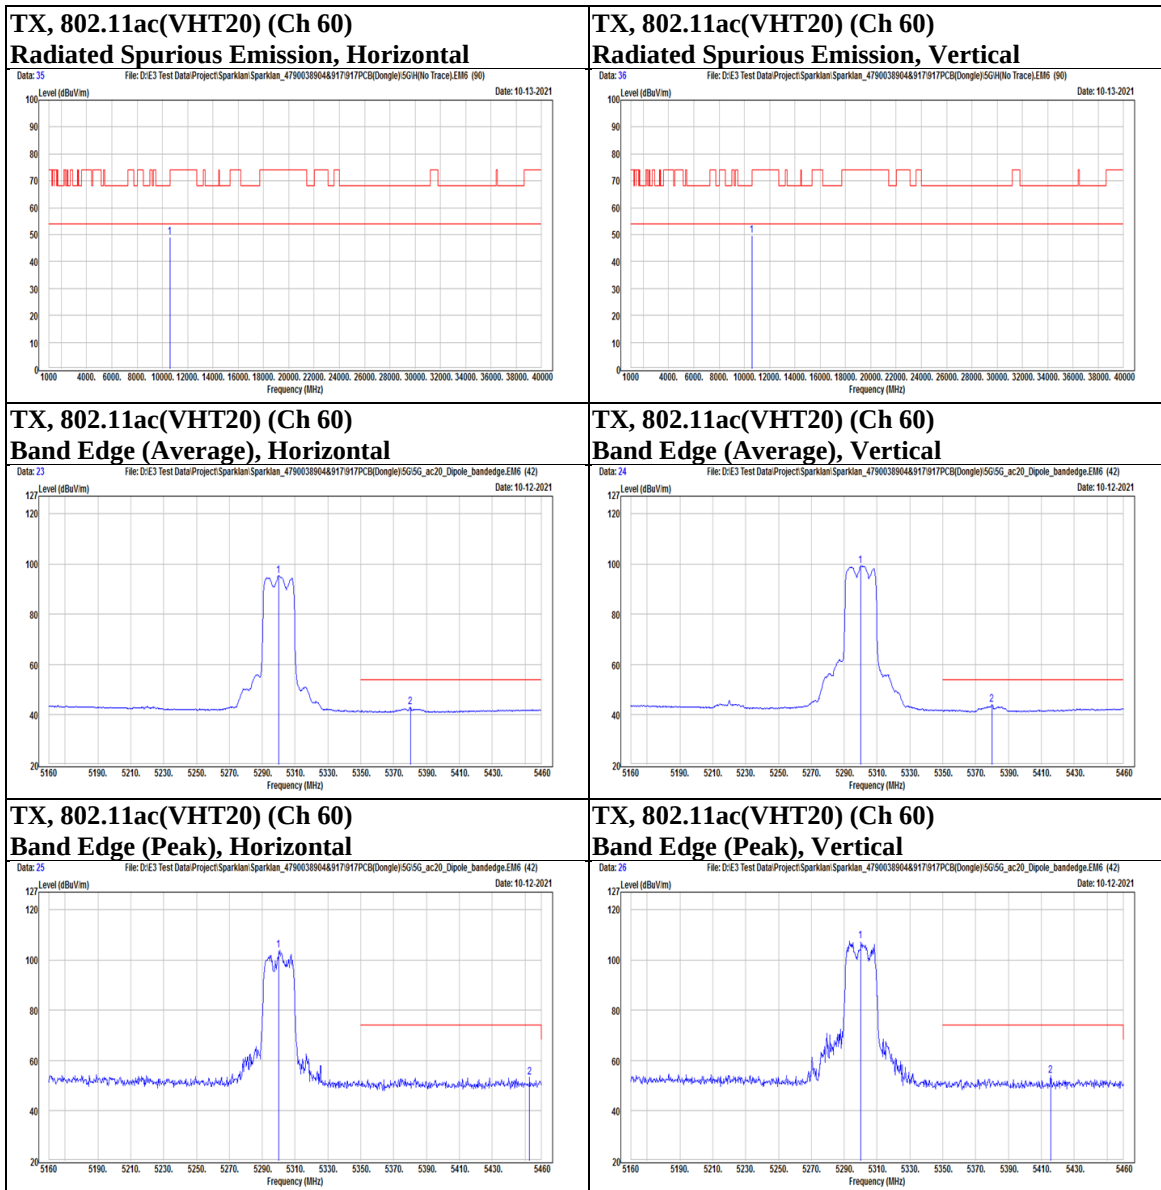



Test report No. : 4790038917B-US-R1-V0
Page : 70 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT20)	Channel	64
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5320	86.7	13.23	99.93	N/A	N/A	PK
	@	5320	78.34	13.23	91.57	N/A	N/A	AVG
		5400	29.17	13.42	42.59	54	-11.41	AVG
		5420.1	39.71	13.52	53.23	74	-20.77	PK
	*	10640	30.65	17.82	48.47	74	-25.53	PK
Vertical	@	5320	91.12	13.23	104.35	N/A	N/A	PK
	@	5320	82.76	13.23	95.99	N/A	N/A	AVG
		5400	30.44	13.42	43.86	54	-10.14	AVG
		5435.4	40.83	13.6	54.43	74	-19.57	PK
	*	10640	31.11	17.82	48.93	74	-25.07	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0

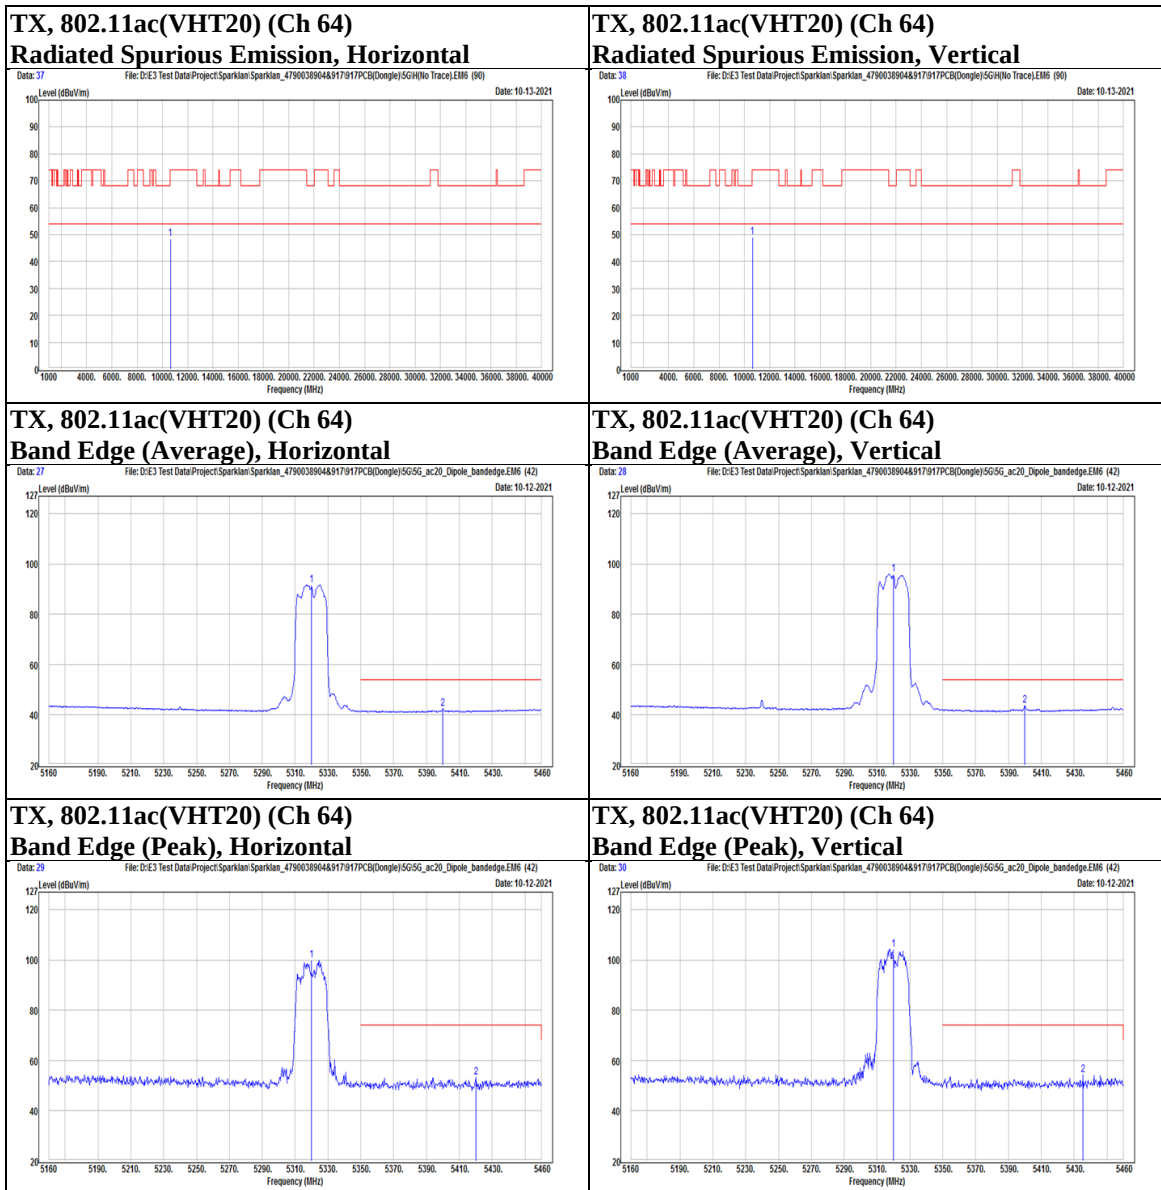



Test report No. : 4790038917B-US-R1-V0
Page : 72 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT20)	Channel	100
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5439.55	39.57	13.63	53.2	74	-20.8	PK
		5439.55	28.29	13.63	41.92	54	-12.08	AVG
		5465.1	41.71	13.72	55.43	68.2	-12.77	PK
	@	5500	92.9	13.83	106.73	N/A	N/A	PK
	@	5500	82.3	13.83	96.13	N/A	N/A	AVG
	*	11000	31.46	18.28	49.74	74	-24.26	PK
Vertical		5443.4	40.32	13.64	53.96	74	-20.04	PK
		5443.4	28.2	13.64	41.84	54	-12.16	AVG
		5467.9	47.24	13.74	60.98	68.2	-7.22	PK
	@	5500	95.94	13.83	109.77	N/A	N/A	PK
	@	5500	85.2	13.83	99.03	N/A	N/A	AVG
	*	11000	30.85	18.28	49.13	74	-24.87	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917B-US-R1-V0
Page : 73 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND


TX, 802.11ac(VHT20) (Ch 100)
Radiated Spurious Emission, Horizontal

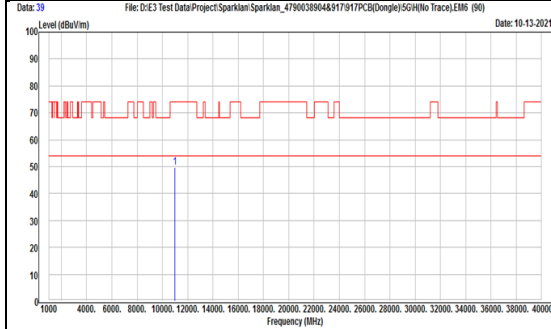


TX, 802.11ac(VHT20) (Ch 100)
Radiated Spurious Emission, Vertical

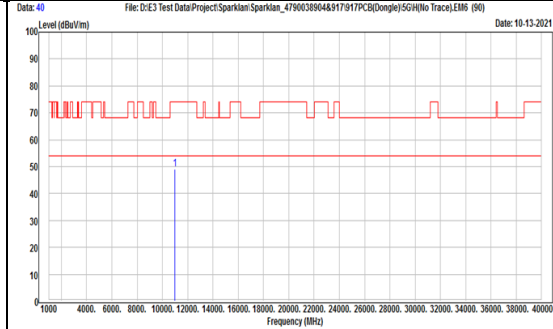

TX, 802.11ac(VHT20) (Ch 100)
Band Edge (Peak), Horizontal

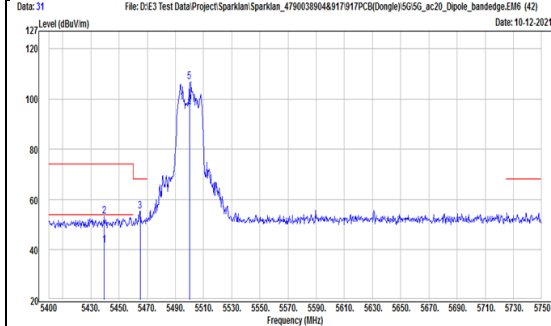

TX, 802.11ac(VHT20) (Ch 100)
Band Edge (Peak), Vertical

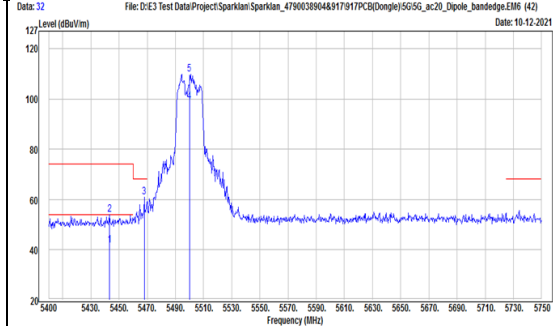

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 74 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT20)	Channel	116
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5444.8	40.98	13.65	54.63	74	-19.37	PK
		5444.8	28.15	13.65	41.8	54	-12.2	AVG
		5465.8	38.86	13.72	52.58	68.2	-15.62	PK
	@	5580	93.05	13.98	107.03	N/A	N/A	PK
	@	5580	83.1	13.98	97.08	N/A	N/A	AVG
		5747.2	40.21	14.29	54.5	68.2	-13.7	PK
	*	11160	32.44	18.32	50.76	74	-23.24	PK
Vertical		5426.6	40.19	13.56	53.75	74	-20.25	PK
		5426.6	28.39	13.56	41.95	54	-12.05	AVG
		5461.6	39.96	13.71	53.67	68.2	-14.53	PK
	@	5580	96.78	13.98	110.76	N/A	N/A	PK
	@	5580	86.2	13.98	100.18	N/A	N/A	AVG
		5748.6	39.53	14.3	53.83	68.2	-14.37	PK
	*	11160	30.99	18.32	49.31	74	-24.69	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 75 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

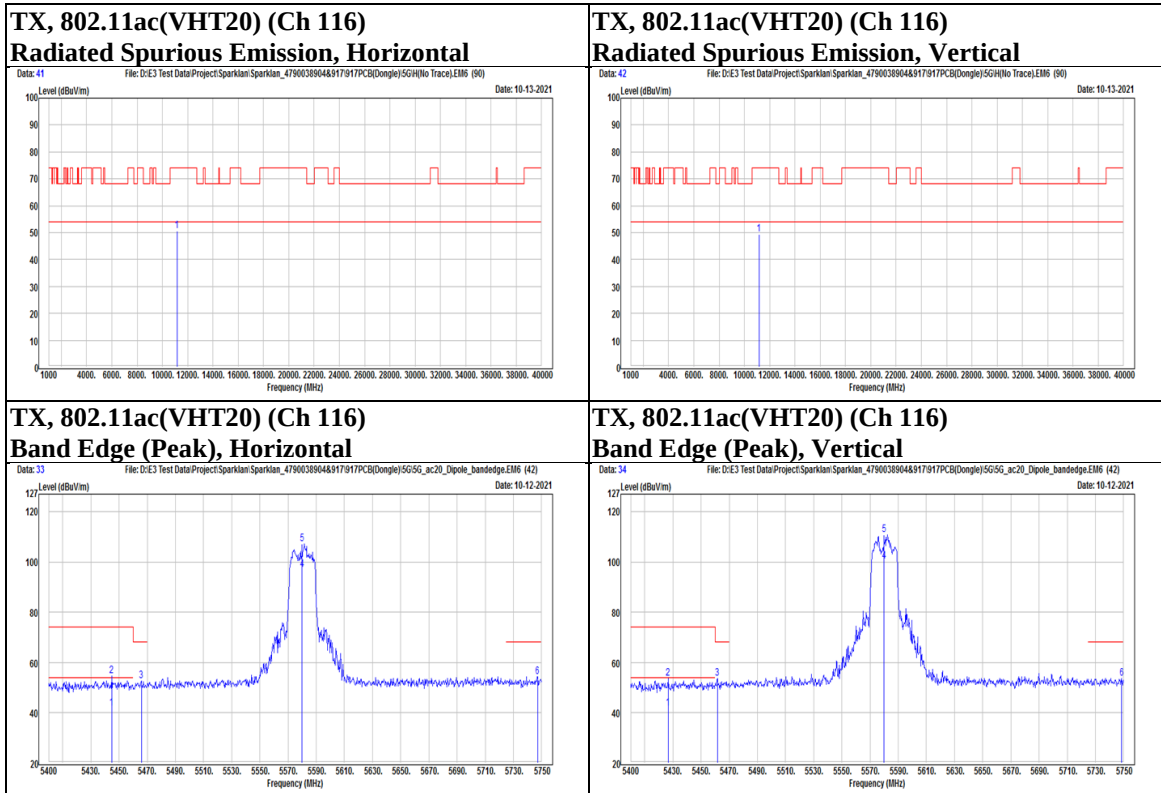

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 76 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT20)	Channel	140
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5700	89.33	14.05	103.38	N/A	N/A	PK
	@	5700	78.8	14.05	92.85	N/A	N/A	AVG
		5732.5	40.42	14.22	54.64	68.2	-13.56	PK
	*	11400	30.61	18.74	49.35	74	-24.65	PK
Vertical	@	5700	91.51	14.05	105.56	N/A	N/A	PK
	@	5700	81.7	14.05	95.75	N/A	N/A	AVG
		5725.5	40.59	14.18	54.77	68.2	-13.43	PK
	*	11400	30.25	18.74	48.99	74	-25.01	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917B-US-R1-V0
Page : 77 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND


TX, 802.11ac(VHT20) (Ch 140)
Radiated Spurious Emission, Horizontal

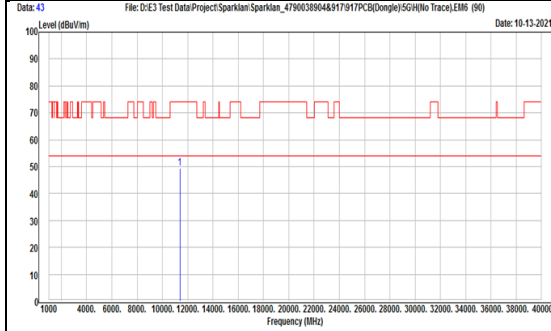


TX, 802.11ac(VHT20) (Ch 140)
Radiated Spurious Emission, Vertical

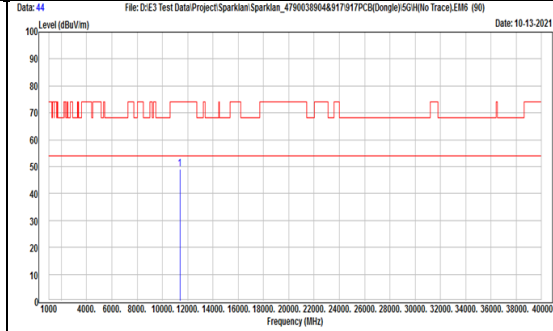

TX, 802.11ac(VHT20) (Ch 140)
Band Edge (Peak), Horizontal

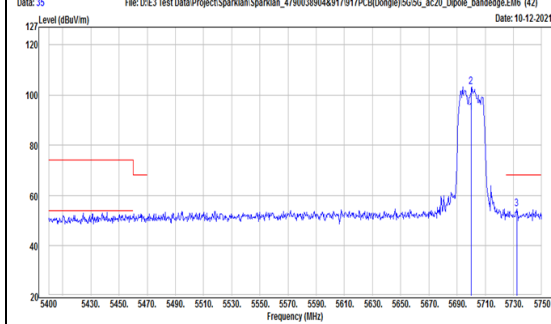

TX, 802.11ac(VHT20) (Ch 140)
Band Edge (Peak), Vertical

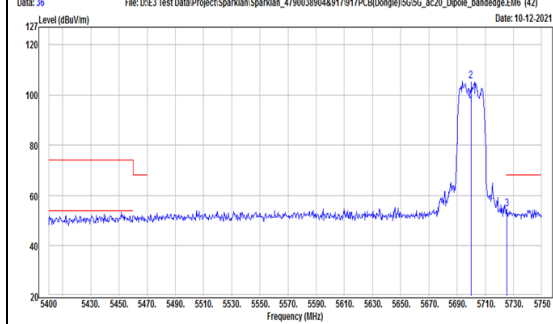

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 78 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT20)	Channel	144
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11440	31.56	18.86	50.42	74	-23.58	PK
Vertical	*	11440	30	18.86	48.86	74	-25.14	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 79 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

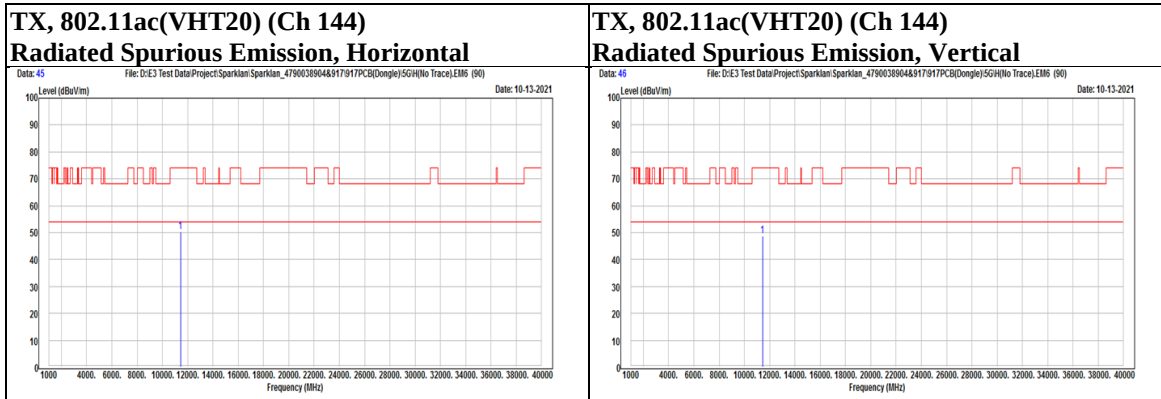

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 80 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT20)	Channel	149
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5647.5	41.08	14.01	55.09	68.2	-13.11	PK
		5695	44.82	14.05	58.87	101.51	-42.64	PK
	@	5745	95.91	14.28	110.19	N/A	N/A	PK
	*	11490	30.4	19.02	49.42	74	-24.58	PK
Vertical		5560.5	41.16	13.92	55.08	68.2	-13.12	PK
		5700	45.12	14.05	59.17	105.2	-46.03	PK
	@	5745	98.88	14.28	113.16	N/A	N/A	PK
	*	11490	33.14	19.02	52.16	74	-21.84	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917B-US-R1-V0
Page : 81 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND


TX, 802.11ac(VHT20) (Ch 149)
Radiated Spurious Emission, Horizontal

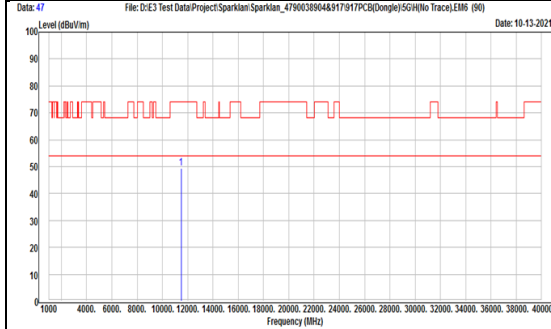


TX, 802.11ac(VHT20) (Ch 149)
Radiated Spurious Emission, Vertical

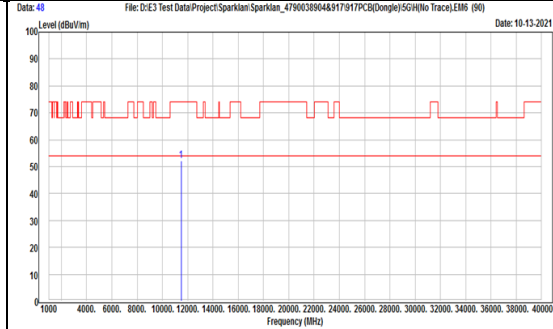

TX, 802.11ac(VHT20) (Ch 149)
Band Edge (Peak), Horizontal

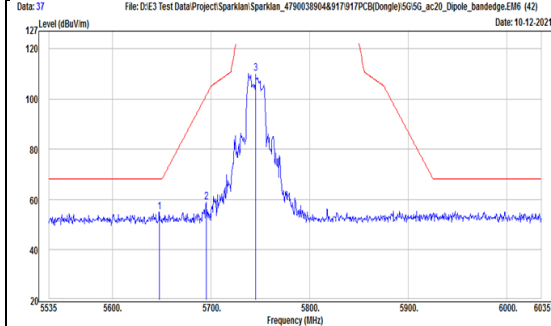

TX, 802.11ac(VHT20) (Ch 149)
Band Edge (Peak), Vertical

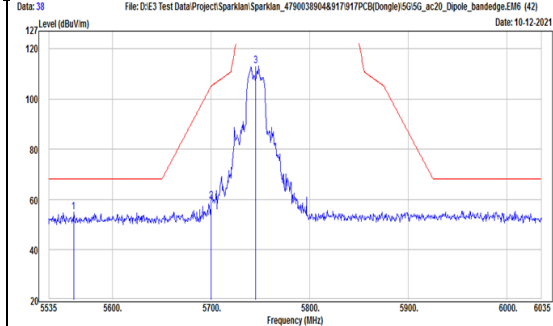

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 82 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT20)	Channel	157
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5626	41.31	14.02	55.33	68.2	-12.87	PK
		5691.5	41.05	14.04	55.09	98.93	-43.84	PK
	@	5785	94.7	14.48	109.18	N/A	N/A	PK
		5892.5	39.91	14.95	54.86	92.21	-37.35	PK
		5936	40.88	15	55.88	68.2	-12.32	PK
	*	11570	30.13	18.88	49.01	74	-24.99	PK
Vertical		5622.5	40.34	14.03	54.37	68.2	-13.83	PK
		5697	40.48	14.05	54.53	102.99	-48.46	PK
	@	5785	98.36	14.48	112.84	N/A	N/A	PK
		5923	40.65	14.99	55.64	69.67	-14.03	PK
		6004.5	40.6	15.18	55.78	68.2	-12.42	PK
	*	11570	30.19	18.88	49.07	74	-24.93	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917B-US-R1-V0
Page : 83 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND


TX, 802.11ac(VHT20) (Ch 157)
Radiated Spurious Emission, Horizontal

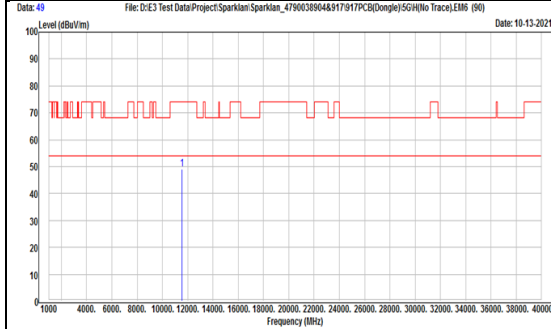


TX, 802.11ac(VHT20) (Ch 157)
Radiated Spurious Emission, Vertical

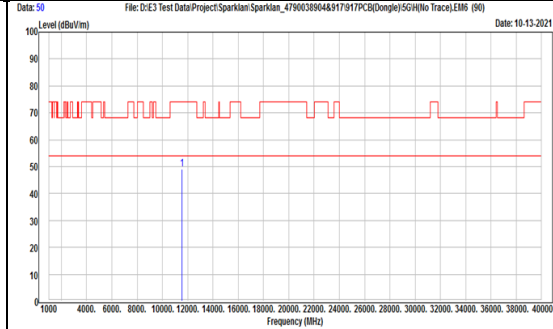

TX, 802.11ac(VHT20) (Ch 157)
Band Edge (Peak), Horizontal

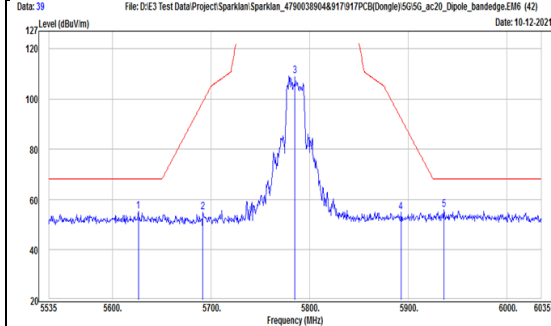

TX, 802.11ac(VHT20) (Ch 157)
Band Edge (Peak), Vertical

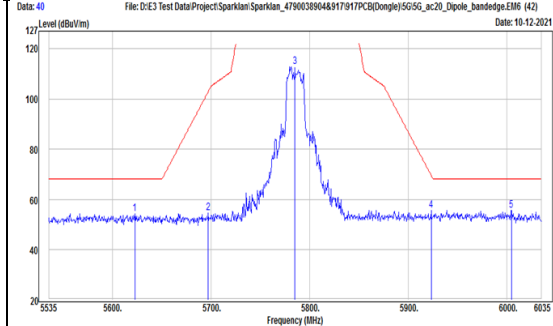

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 84 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT20)	Channel	165
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5825	92.98	14.69	107.67	N/A	N/A	PK
		5904	40.3	14.98	55.28	83.7	-28.42	PK
		5983.5	40.38	15.12	55.5	68.2	-12.7	PK
	*	11650	30.16	18.63	48.79	74	-25.21	PK
Vertical	@	5825	96.68	14.69	111.37	N/A	N/A	PK
		5876.5	40.95	14.89	55.84	104.09	-48.25	PK
		5961	40.29	15.05	55.34	68.2	-12.86	PK
	*	11650	30.49	18.63	49.12	74	-24.88	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 85 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

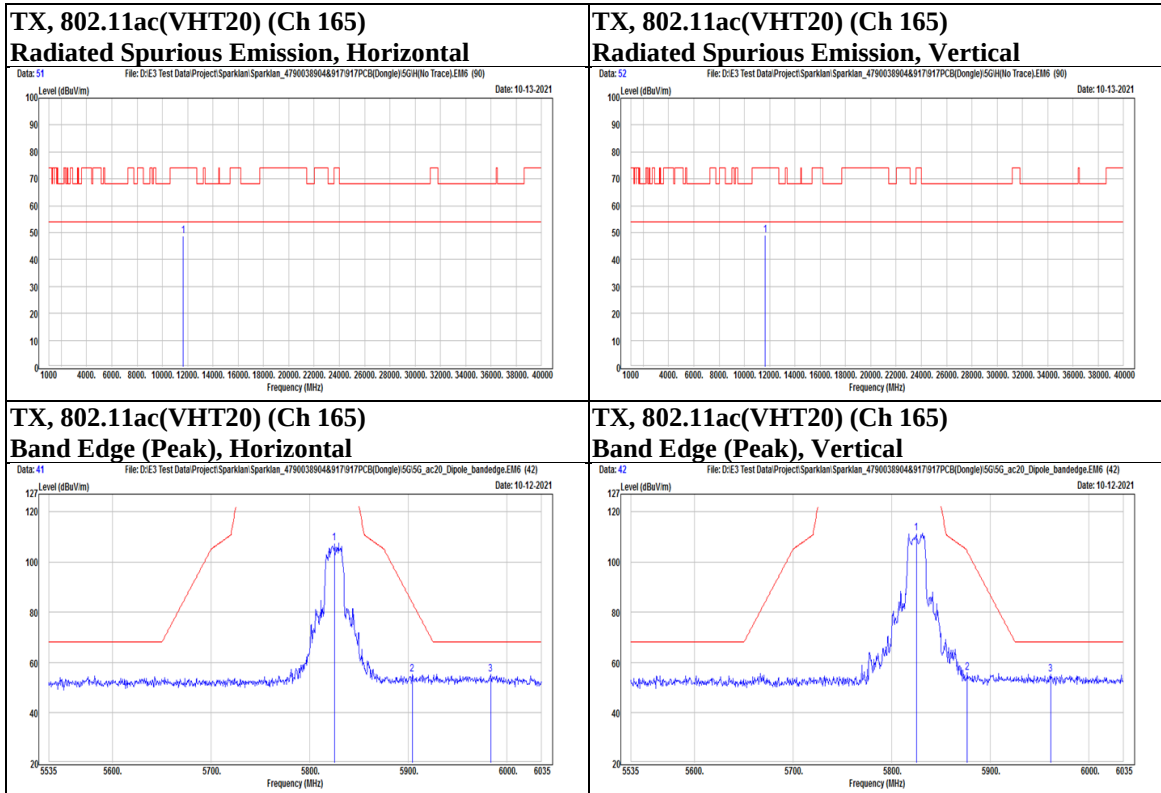

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 86 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT40)	Channel	38
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5100.8	30.35	13.46	43.81	54	-10.19	AVG
		5119.7	42.1	13.45	55.55	74	-18.45	PK
	@	5190	81.58	13.4	94.98	N/A	N/A	PK
	@	5190	73.11	13.4	86.51	N/A	N/A	AVG
		10380	31.2	17.49	48.69	68.2	-19.51	PK
Vertical		5041.3	42.09	13.2	55.29	74	-18.71	PK
		5149.8	31.21	13.43	44.64	54	-9.36	AVG
	@	5190	85.73	13.4	99.13	N/A	N/A	PK
	@	5190	78.26	13.4	91.66	N/A	N/A	AVG
		10380	31.59	17.49	49.08	68.2	-19.12	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 87 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

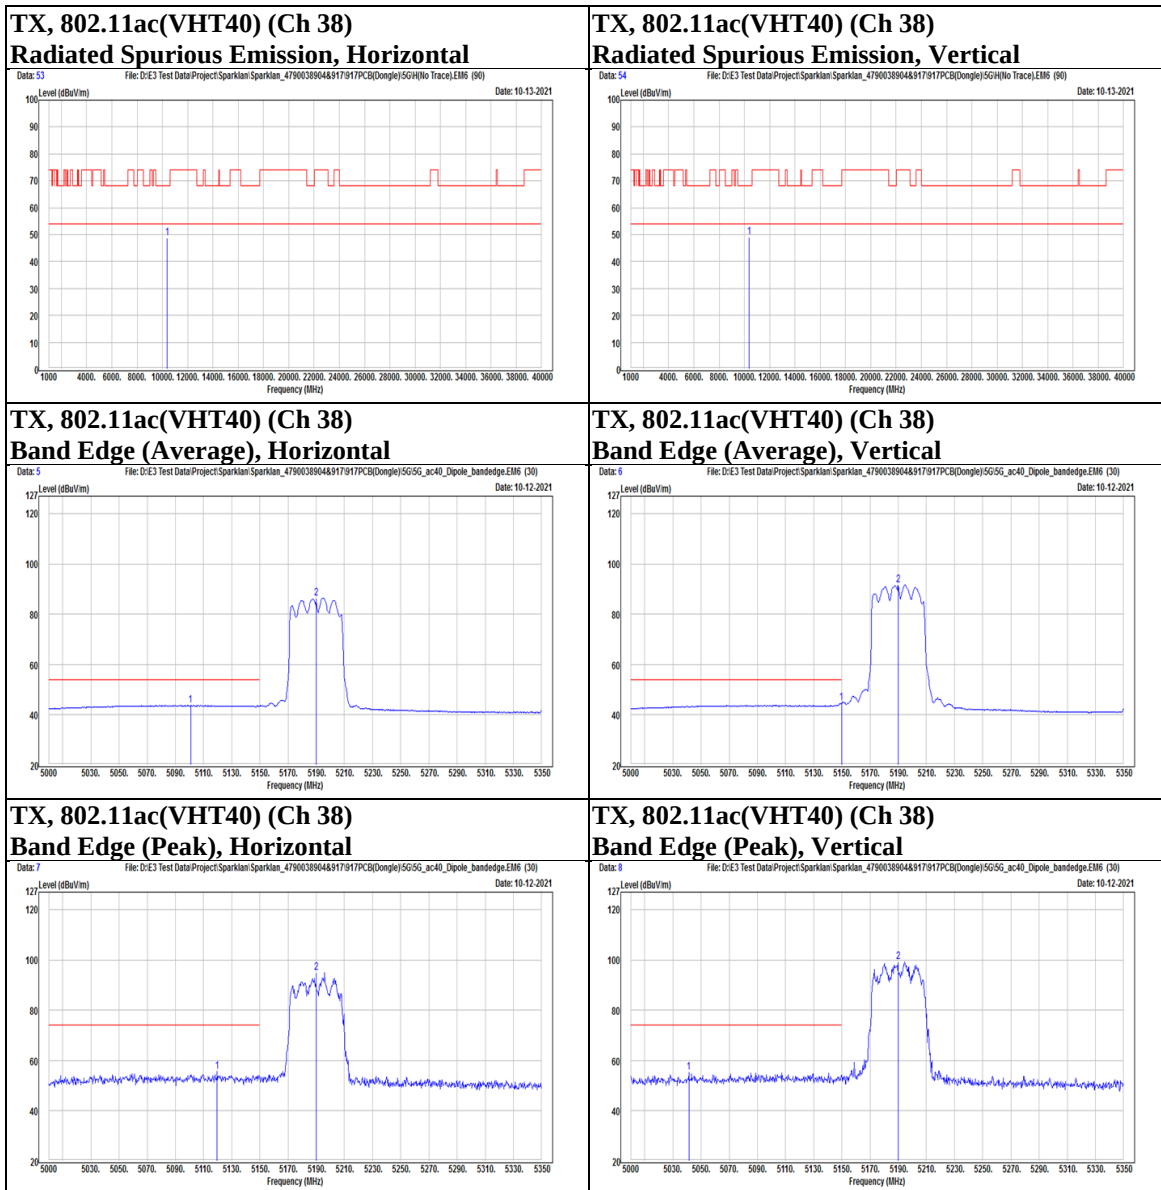

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 88 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT40)	Channel	46
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5068.25	41.69	13.36	55.05	74	-18.95	PK
		5092.75	30.42	13.44	43.86	54	-10.14	AVG
	@	5230	87.67	13.3	100.97	N/A	N/A	PK
	@	5230	80.87	13.3	94.17	N/A	N/A	AVG
		10460	31.33	17.66	48.99	68.2	-19.21	PK
Vertical		5116.55	30.92	13.46	44.38	54	-9.62	AVG
		5137.55	42.76	13.43	56.19	74	-17.81	PK
	@	5230	93.67	13.3	106.97	N/A	N/A	PK
	@	5230	86.02	13.3	99.32	N/A	N/A	AVG
		10460	32.15	17.66	49.81	68.2	-18.39	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 89 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

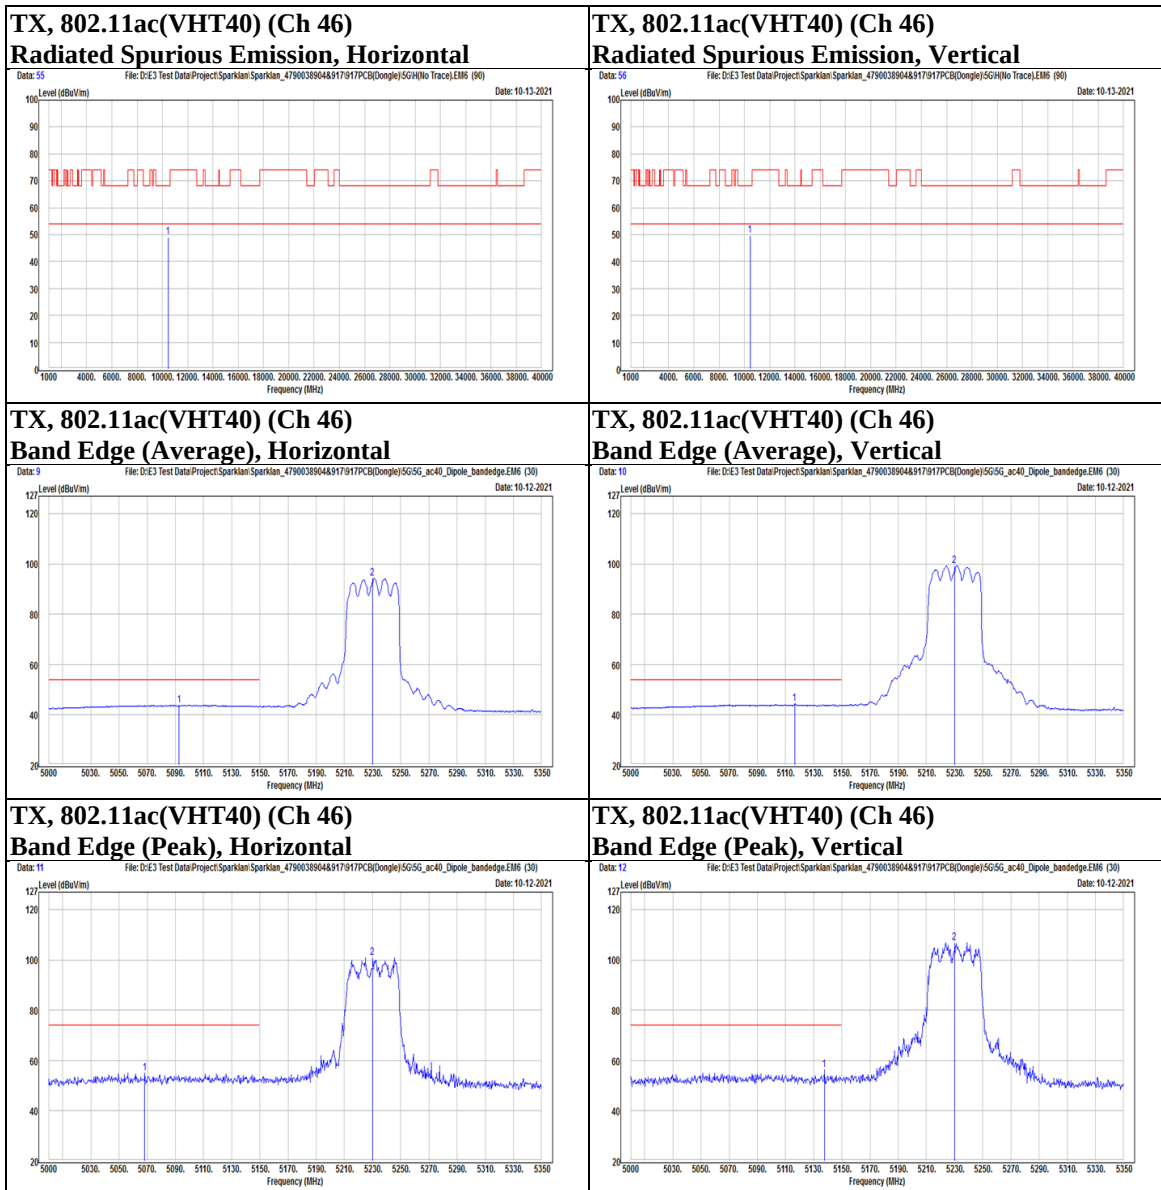

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 90 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT40)	Channel	54
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5270	88.64	13.22	101.86	N/A	N/A	PK
	@	5270	80.49	13.22	93.71	N/A	N/A	AVG
		5457.6	28.39	13.7	42.09	54	-11.91	AVG
		5459.7	40.11	13.7	53.81	74	-20.19	PK
		10540	31.42	17.72	49.14	68.2	-19.06	PK
Vertical	@	5270	94.07	13.22	107.29	N/A	N/A	PK
	@	5270	84.74	13.22	97.96	N/A	N/A	AVG
		5372.4	40.75	13.33	54.08	74	-19.92	PK
		5450.1	29.02	13.67	42.69	54	-11.31	AVG
		10540	31.57	17.72	49.29	68.2	-18.91	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 91 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

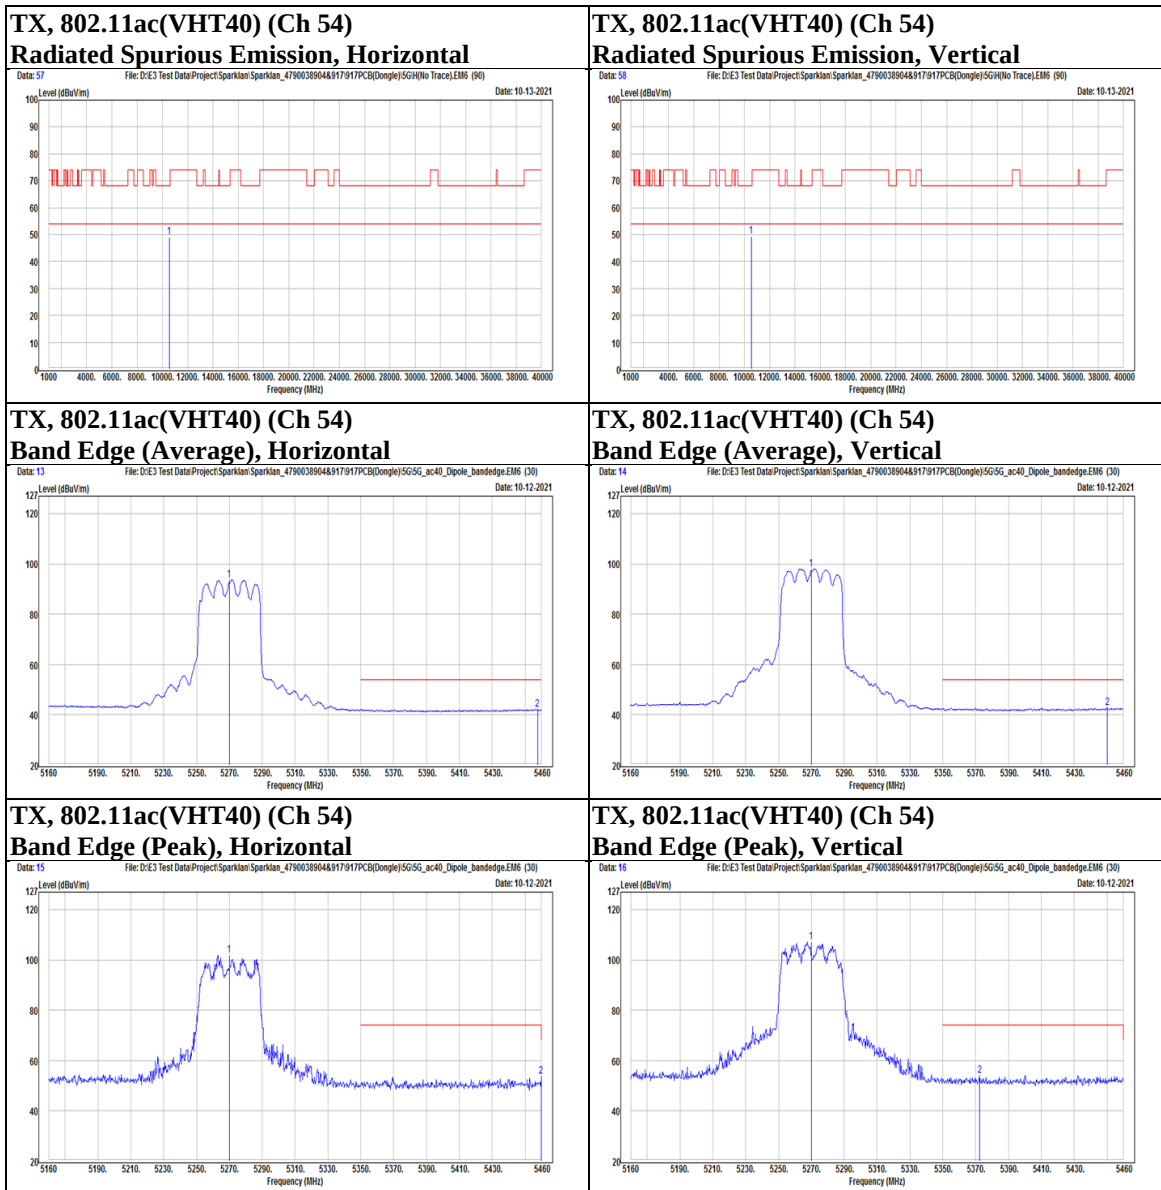

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 92 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT40)	Channel	62
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5310	81.16	13.21	94.37	N/A	N/A	PK
	@	5310	74.35	13.21	87.56	N/A	N/A	AVG
		5369.7	40.1	13.33	53.43	74	-20.57	PK
		5389.8	29.07	13.38	42.45	54	-11.55	AVG
	*	10620	31.47	17.78	49.25	74	-24.75	PK
Vertical	@	5310	84.83	13.21	98.04	N/A	N/A	PK
	@	5310	77.87	13.21	91.08	N/A	N/A	AVG
		5390.1	31.13	13.39	44.52	54	-9.48	AVG
		5459.4	40.14	13.7	53.84	74	-20.16	PK
	*	10620	31.74	17.78	49.52	74	-24.48	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 93 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

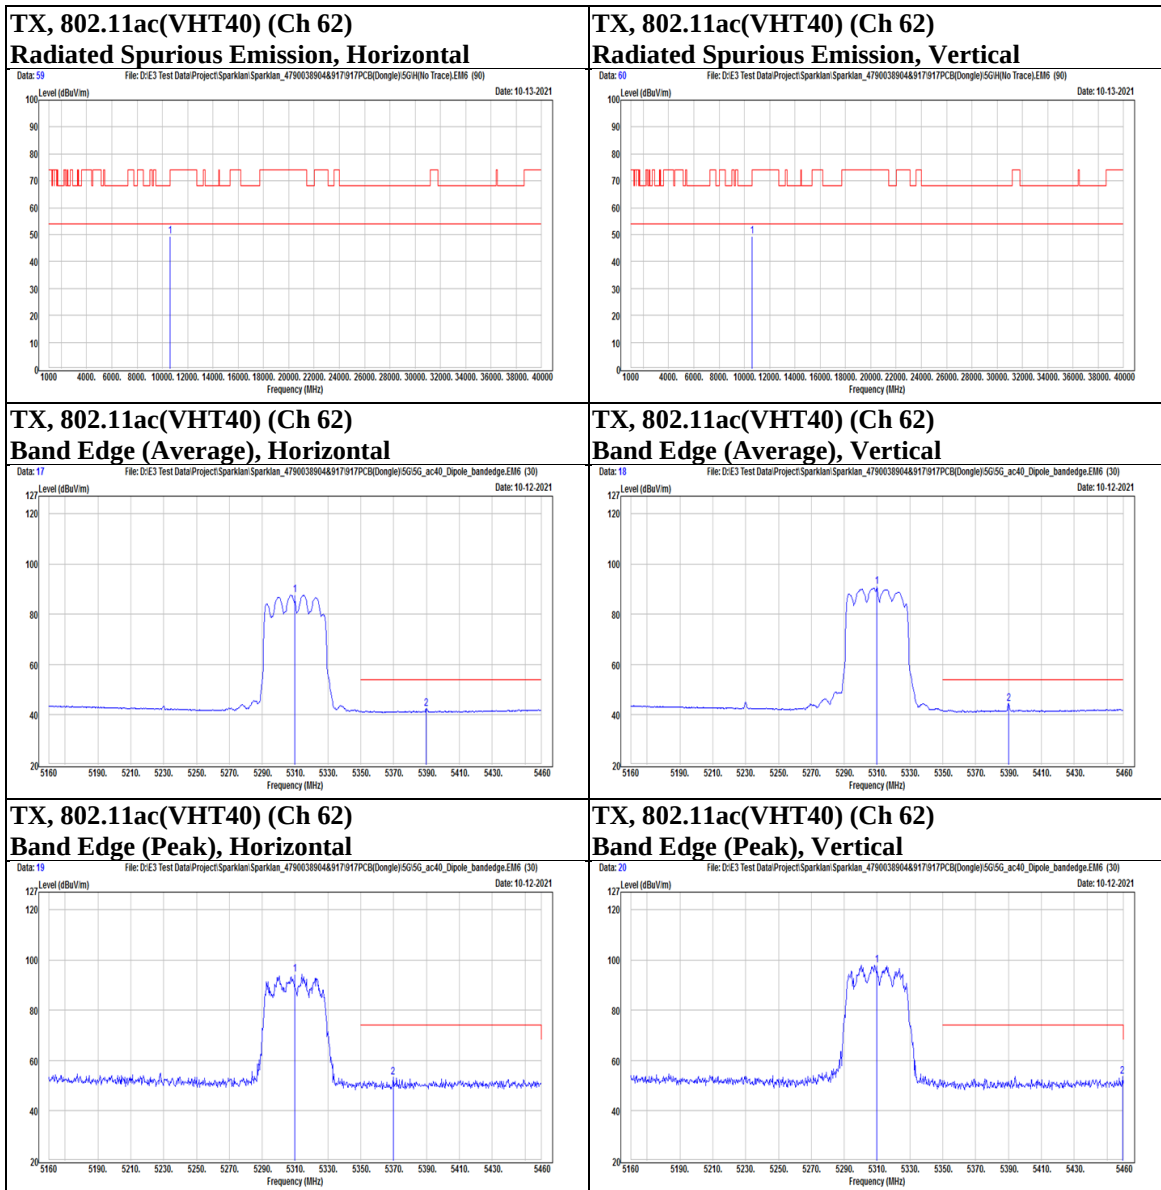

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 94 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT40)	Channel	102
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5444.8	38.85	13.65	52.5	74	-21.5	PK
		5444.8	28.3	13.65	41.95	54	-12.05	AVG
		5464.4	38.99	13.72	52.71	68.2	-15.49	PK
	@	5510	82.96	13.84	96.8	N/A	N/A	PK
	@	5510	72.5	13.84	86.34	N/A	N/A	AVG
	*	11020	31.3	18.32	49.62	74	-24.38	PK
Vertical		5435.35	40.79	13.6	54.39	74	-19.61	PK
		5435.35	28.1	13.6	41.7	54	-12.3	AVG
		5460.2	41.55	13.7	55.25	68.2	-12.95	PK
	@	5510	88.74	13.84	102.58	N/A	N/A	PK
	@	5510	78.5	13.84	92.34	N/A	N/A	AVG
	*	11020	31.61	18.32	49.93	74	-24.07	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917B-US-R1-V0
Page : 95 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND


TX, 802.11ac(VHT40) (Ch 102)
Radiated Spurious Emission, Horizontal

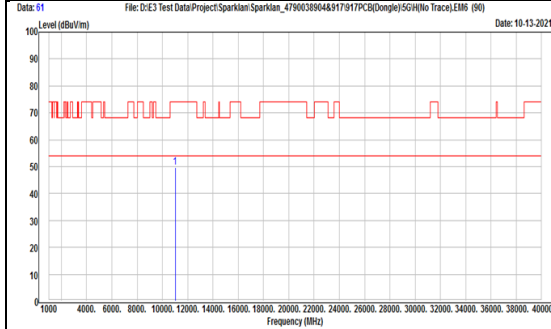


TX, 802.11ac(VHT40) (Ch 102)
Radiated Spurious Emission, Vertical

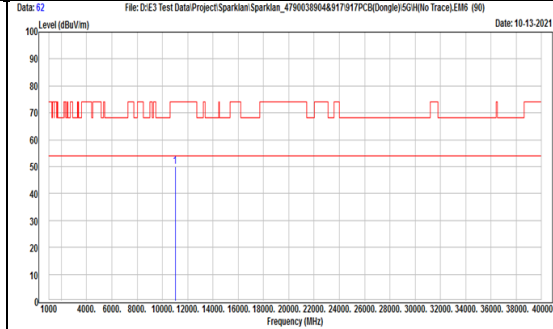

TX, 802.11ac(VHT40) (Ch 102)
Band Edge (Peak), Horizontal

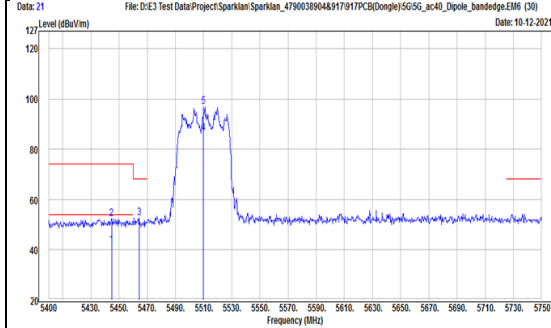

TX, 802.11ac(VHT40) (Ch 102)
Band Edge (Peak), Vertical

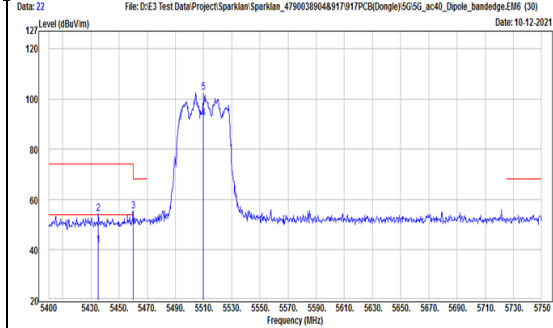

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 96 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT40)	Channel	110
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5415.75	39.51	13.49	53	74	-21	PK
		5415.75	28.41	13.49	41.9	54	-12.1	AVG
		5463.7	40.67	13.72	54.39	68.2	-13.81	PK
	@	5550	92.61	13.88	106.49	N/A	N/A	PK
	@	5550	82.11	13.88	95.99	N/A	N/A	AVG
		5734.6	41.57	14.23	55.8	68.2	-12.4	PK
	*	11100	31.53	18.49	50.02	74	-23.98	PK
Vertical		5458.45	42.1	13.7	55.8	74	-18.2	PK
		5458.45	30.6	13.7	44.3	54	-9.7	AVG
		5469.65	43.69	13.74	57.43	68.2	-10.77	PK
	@	5550	95.14	13.88	109.02	N/A	N/A	PK
	@	5550	85.21	13.88	99.09	N/A	N/A	AVG
		5744.05	39.92	14.28	54.2	68.2	-14	PK
	*	11100	31.05	18.49	49.54	74	-24.46	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917B-US-R1-V0
Page : 97 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND


TX, 802.11ac(VHT40) (Ch 110)
Radiated Spurious Emission, Horizontal

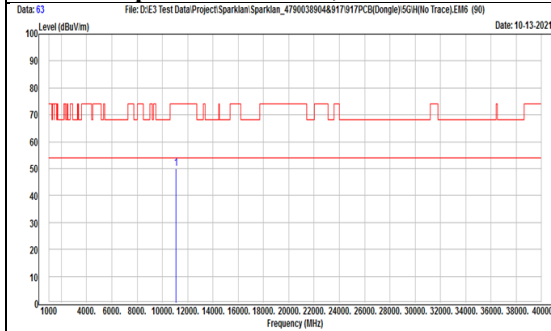


TX, 802.11ac(VHT40) (Ch 110)
Radiated Spurious Emission, Vertical

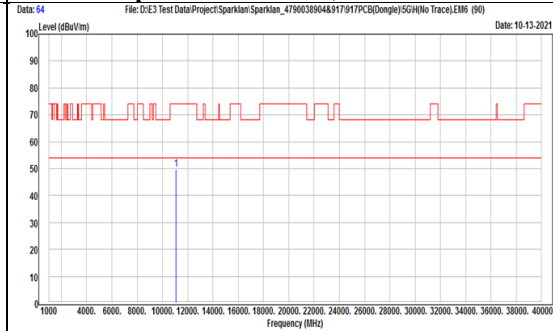

TX, 802.11ac(VHT40) (Ch 110)
Band Edge (Peak), Horizontal

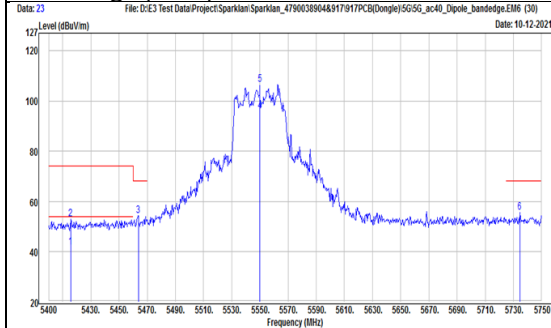

TX, 802.11ac(VHT40) (Ch 110)
Band Edge (Peak), Vertical

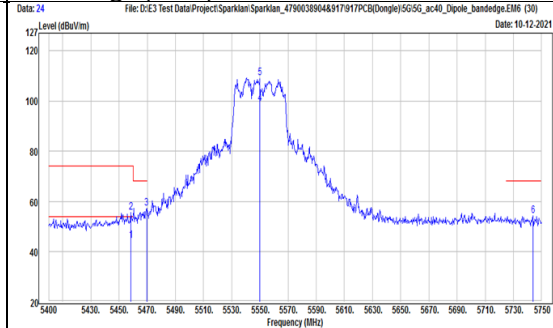

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 98 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT40)	Channel	134
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5670	89.67	14.02	103.69	N/A	N/A	PK
	@	5670	79.5	14.02	93.52	N/A	N/A	AVG
		5737.05	40.02	14.24	54.26	68.2	-13.94	PK
	*	11340	29.54	18.55	48.09	74	-25.91	PK
Vertical	@	5670	92.04	14.02	106.06	N/A	N/A	PK
	@	5670	82.3	14.02	96.32	N/A	N/A	AVG
		5727.95	42.21	14.19	56.4	68.2	-11.8	PK
	*	11340	30.59	18.55	49.14	74	-24.86	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917B-US-R1-V0
Page : 99 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND


TX, 802.11ac(VHT40) (Ch 134)
Radiated Spurious Emission, Horizontal

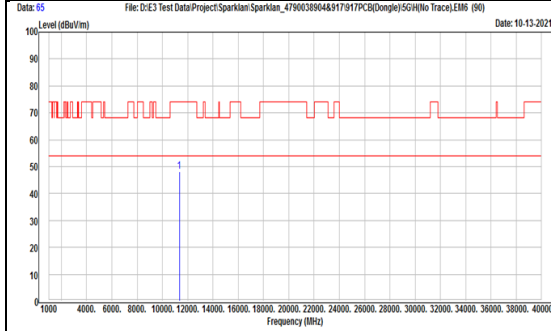


TX, 802.11ac(VHT40) (Ch 134)
Radiated Spurious Emission, Vertical

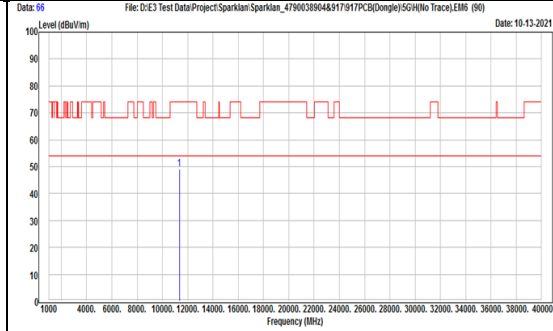

TX, 802.11ac(VHT40) (Ch 134)
Band Edge (Peak), Horizontal

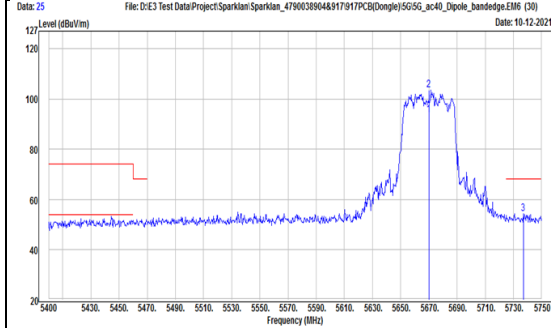

TX, 802.11ac(VHT40) (Ch 134)
Band Edge (Peak), Vertical

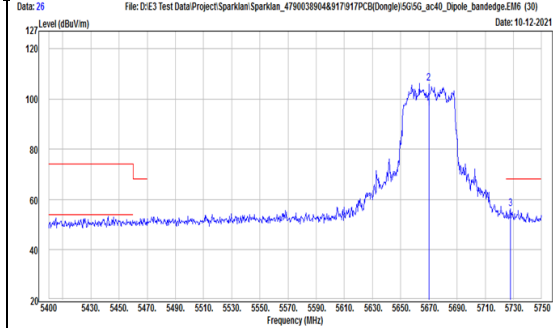

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 100 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT40)	Channel	142
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11420	30.61	18.8	49.41	74	-24.59	PK
Vertical	*	11420	30.89	18.8	49.69	74	-24.31	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 101 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

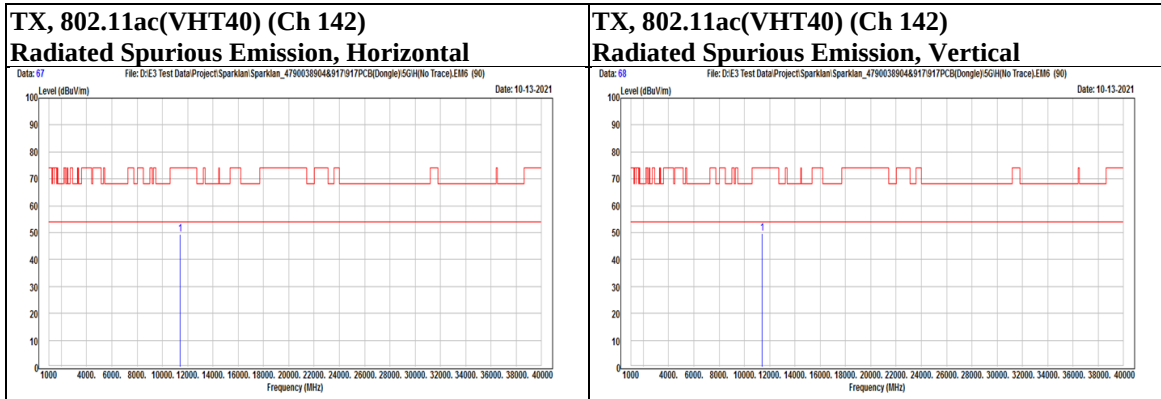

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 102 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT40)	Channel	151
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5552	40.85	13.89	54.74	68.2	-13.46	PK
		5693.5	49.76	14.05	63.81	100.41	-36.6	PK
	@	5755	91.97	14.33	106.3	N/A	N/A	PK
	*	11510	31.21	19.03	50.24	74	-23.76	PK
Vertical		5649	41.55	14	55.55	68.2	-12.65	PK
		5700	51.59	14.05	65.64	105.2	-39.56	PK
	@	5755	95.03	14.33	109.36	N/A	N/A	PK
	*	11510	31.69	19.03	50.72	74	-23.28	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790038917B-US-R1-V0
Page : 103 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND


TX, 802.11ac(VHT40) (Ch 151)
Radiated Spurious Emission, Horizontal

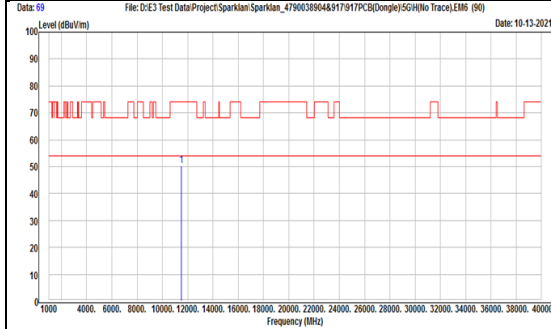


TX, 802.11ac(VHT40) (Ch 151)
Radiated Spurious Emission, Vertical

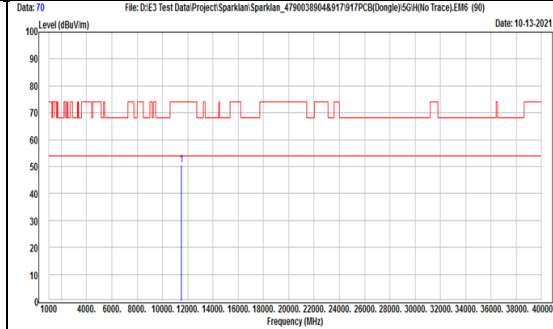

TX, 802.11ac(VHT40) (Ch 151)
Band Edge (Peak), Horizontal

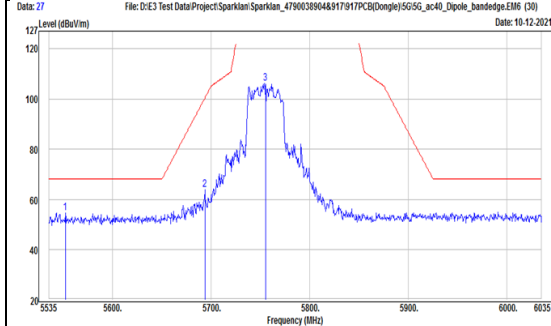

TX, 802.11ac(VHT40) (Ch 151)
Band Edge (Peak), Vertical

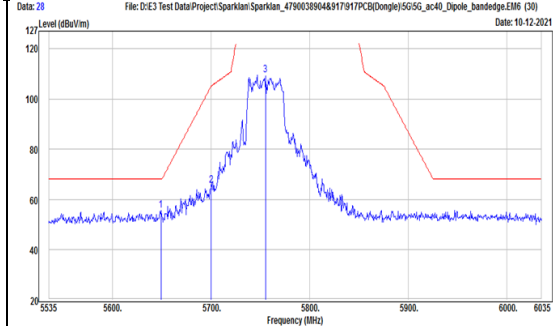

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790038917B-US-R1-V0
Page : 104 of 123
Issued date : 2022/1/13
FCC ID : RYK-WUBT239ACND

Mode	802.11ac(VHT40)	Channel	159
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5795	90.62	14.53	105.15	N/A	N/A	PK
		5919	40.52	14.98	55.5	72.62	-17.12	PK
		6004	41.52	15.18	56.7	68.2	-11.5	PK
	*	11590	31.36	18.84	50.2	74	-23.8	PK
Vertical	@	5795	94.77	14.53	109.3	N/A	N/A	PK
		5877.5	43.38	14.89	58.27	103.34	-45.07	PK
		5952.5	40.79	15.03	55.82	68.2	-12.38	PK
	*	11590	30.18	18.84	49.02	74	-24.98	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0