





11N40MIMO_Ant0_Low_2422




11N40MIMO_Ant1_Low_2422

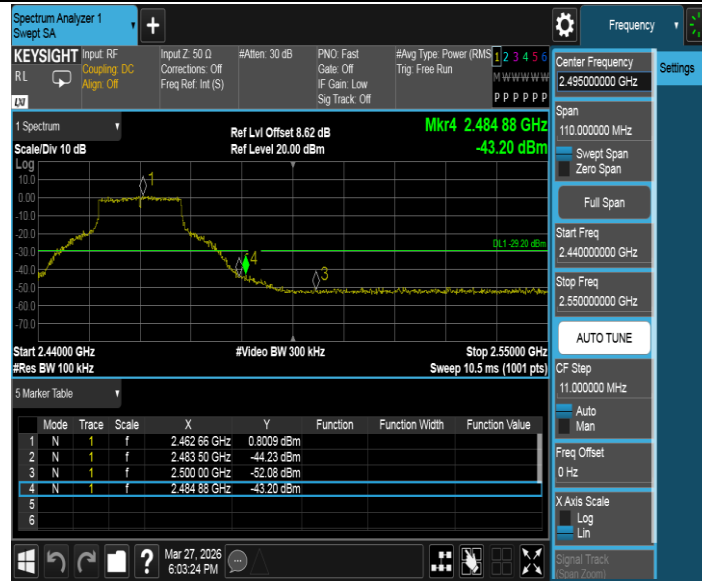

11N40MIMO_Ant0_High_2452

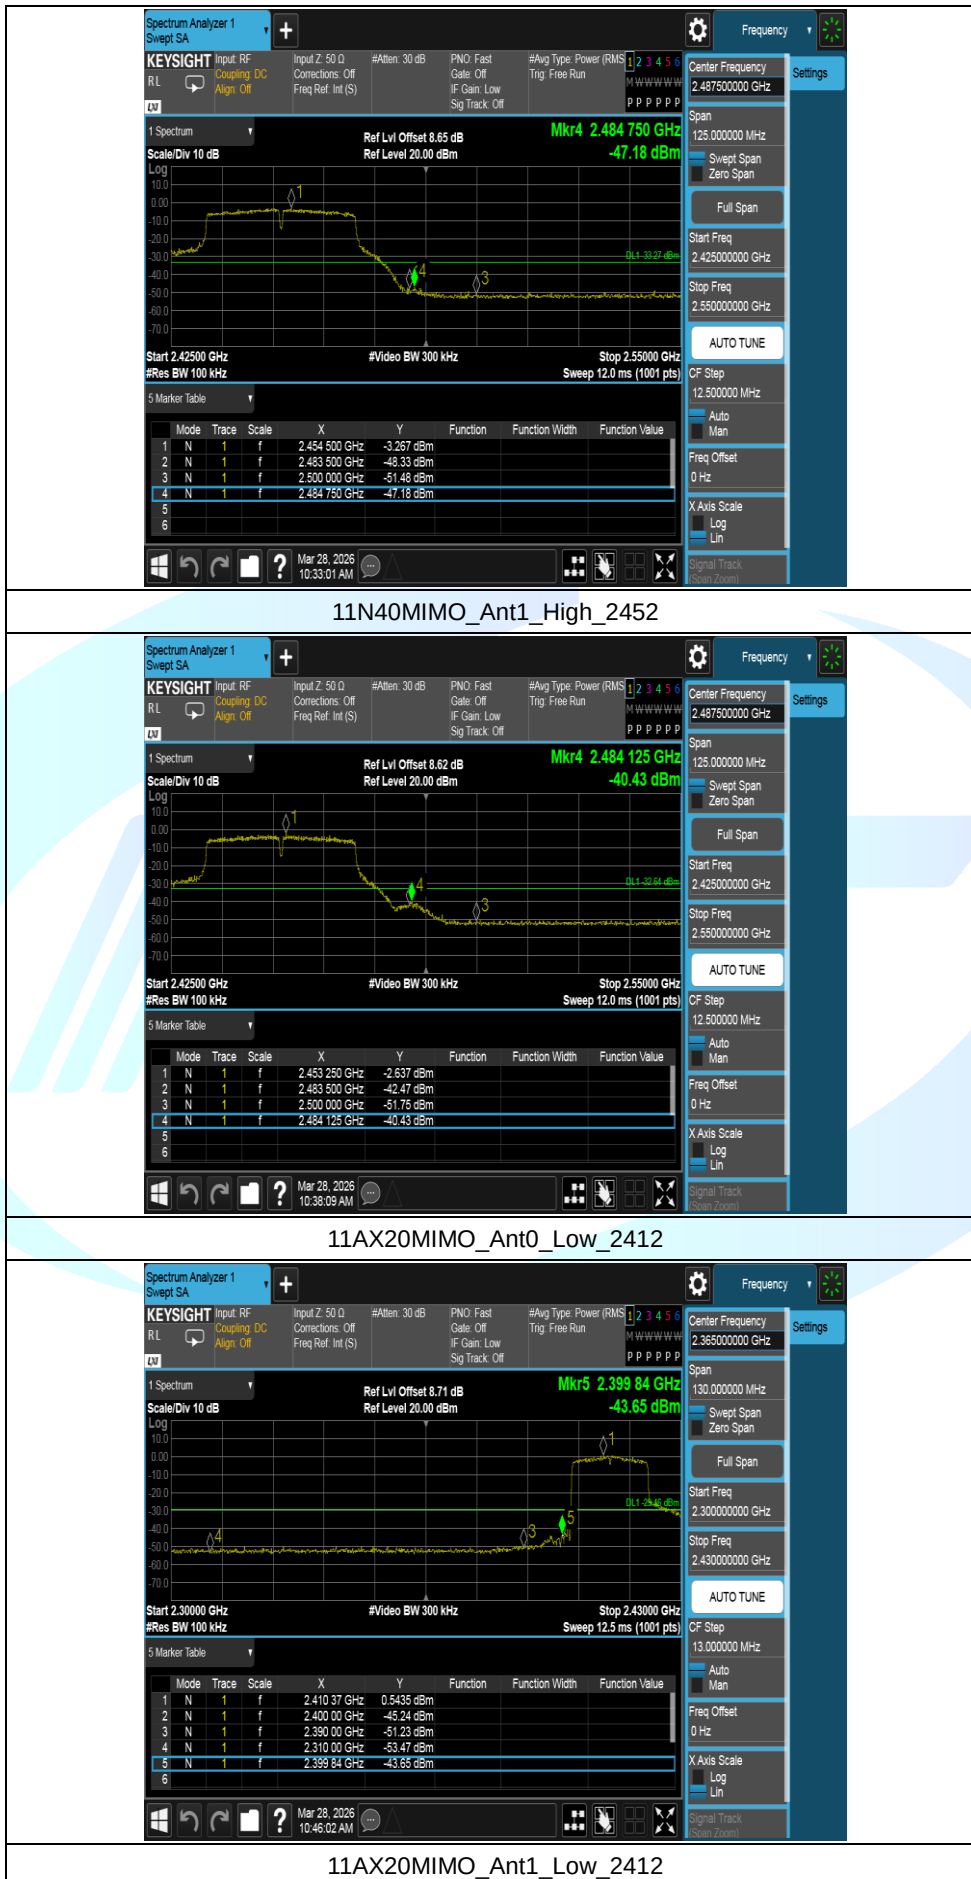

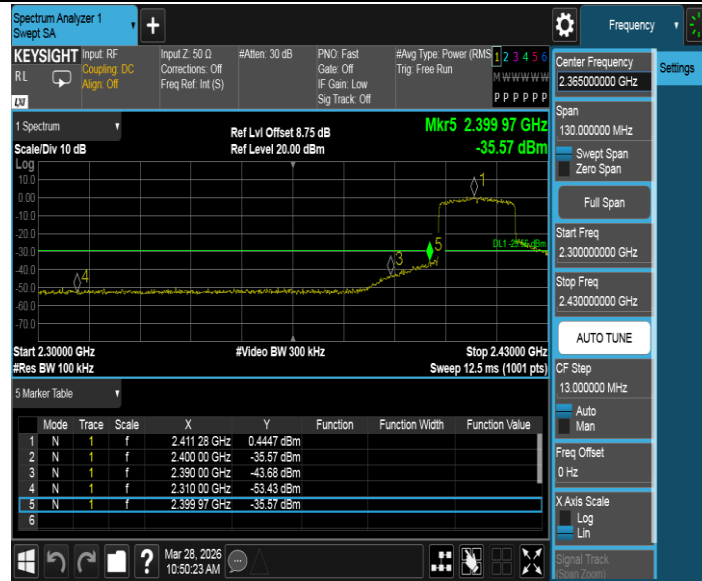


11AX20MIMO_Ant0_High_2462



11AX20MIMO_Ant1_High_2462



11AX40MIMO_Ant0_Low_2422

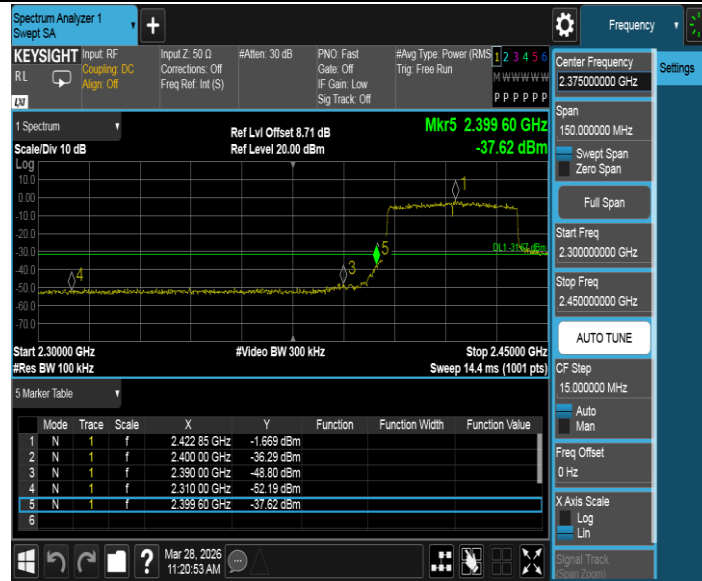

11AX40MIMO_Ant1_High_2452



Conducted Spurious Emission

Test Mode	Antenna	Frequency [MHz]	Freq Range [Mhz]	Ref Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant0	2412	Reference	7.35	7.35	---	PASS
			30~1000	7.35	-52.29	≤-22.65	PASS
			1000~26500	7.35	-38	≤-22.65	PASS
	Ant1	2412	Reference	7.38	7.38	---	PASS
			30~1000	7.38	-52.18	≤-22.62	PASS
			1000~26500	7.38	-38.18	≤-22.62	PASS
	Ant0	2437	Reference	7.49	7.49	---	PASS
			30~1000	7.49	-52.38	≤-22.51	PASS
			1000~26500	7.49	-38.47	≤-22.51	PASS
	Ant1	2437	Reference	7.43	7.43	---	PASS
			30~1000	7.43	-52.48	≤-22.57	PASS
			1000~26500	7.43	-37.97	≤-22.57	PASS
	Ant0	2462	Reference	7.41	7.41	---	PASS
			30~1000	7.41	-52.68	≤-22.59	PASS
			1000~26500	7.41	-37.83	≤-22.59	PASS
	Ant1	2462	Reference	7.34	7.34	---	PASS
			30~1000	7.34	-51.81	≤-22.66	PASS
			1000~26500	7.34	-37.24	≤-22.66	PASS
11G	Ant0	2412	Reference	2.86	2.86	---	PASS
			30~1000	2.86	-51.84	≤-27.14	PASS
			1000~26500	2.86	-34.39	≤-27.14	PASS
	Ant1	2412	Reference	2.51	2.51	---	PASS
			30~1000	2.51	-52.16	≤-27.49	PASS
			1000~26500	2.51	-37.56	≤-27.49	PASS
	Ant0	2437	Reference	2.00	2.00	---	PASS
			30~1000	2.00	-51.41	≤-28	PASS
			1000~26500	2.00	-33.51	≤-28	PASS
	Ant1	2437	Reference	2.00	2.00	---	PASS
			30~1000	2.00	-51.35	≤-28	PASS
			1000~26500	2.00	-38.05	≤-28	PASS
	Ant0	2462	Reference	1.70	1.70	---	PASS
			30~1000	1.70	-52.31	≤-28.3	PASS
			1000~26500	1.70	-37.75	≤-28.3	PASS
	Ant1	2462	Reference	1.75	1.75	---	PASS
			30~1000	1.75	-51.82	≤-28.25	PASS
			1000~26500	1.75	-37.25	≤-28.25	PASS
11N20MIMO	Ant0	2412	Reference	0.81	0.81	---	PASS
			30~1000	0.81	-52.2	≤-29.19	PASS
			1000~26500	0.81	-38.12	≤-29.19	PASS
	Ant1	2412	Reference	2.64	2.64	---	PASS
			30~1000	2.64	-51.71	≤-27.36	PASS

	Ant0	2437	1000~26500	2.64	-37.84	≤ -27.36	PASS
			Reference	0.18	0.18	---	PASS
			30~1000	0.18	-52.11	≤ -29.82	PASS
			1000~26500	0.18	-37.87	≤ -29.82	PASS
	Ant1	2437	Reference	1.64	1.64	---	PASS
			30~1000	1.64	-51.72	≤ -28.36	PASS
			1000~26500	1.64	-36.32	≤ -28.36	PASS
	Ant0	2462	Reference	-0.19	-0.19	---	PASS
			30~1000	-0.19	-51.82	≤ -30.19	PASS
			1000~26500	-0.19	-34.72	≤ -30.19	PASS
	Ant1	2462	Reference	2.12	2.12	---	PASS
			30~1000	2.12	-52.26	≤ -27.88	PASS
			1000~26500	2.12	-35.65	≤ -27.88	PASS
11N40MIMO	Ant0	2422	Reference	-2.63	-2.63	---	PASS
			30~1000	-2.63	-52.33	≤ -32.63	PASS
			1000~26500	-2.63	-38.05	≤ -32.63	PASS
	Ant1	2422	Reference	-2.62	-2.62	---	PASS
			30~1000	-2.62	-52.12	≤ -32.62	PASS
			1000~26500	-2.62	-37.79	≤ -32.62	PASS
	Ant0	2437	Reference	-3.53	-3.53	---	PASS
			30~1000	-3.53	-51.77	≤ -33.53	PASS
			1000~26500	-3.53	-38.54	≤ -33.53	PASS
	Ant1	2437	Reference	-3.24	-3.24	---	PASS
			30~1000	-3.24	-51.9	≤ -33.24	PASS
			1000~26500	-3.24	-37.74	≤ -33.24	PASS
	Ant0	2452	Reference	-3.23	-3.23	---	PASS
			30~1000	-3.23	-51.98	≤ -33.23	PASS
			1000~26500	-3.23	-37.43	≤ -33.23	PASS
	Ant1	2452	Reference	-2.35	-2.35	---	PASS
			30~1000	-2.35	-52.1	≤ -32.35	PASS
			1000~26500	-2.35	-37.83	≤ -32.35	PASS
11AX20MIMO	Ant0	2412	Reference	0.87	0.87	---	PASS
			30~1000	0.87	-52.45	≤ -29.13	PASS
			1000~26500	0.87	-37.46	≤ -29.13	PASS
	Ant1	2412	Reference	0.76	0.76	---	PASS
			30~1000	0.76	-52.82	≤ -29.24	PASS
			1000~26500	0.76	-37.26	≤ -29.24	PASS
	Ant0	2437	Reference	0.23	0.23	---	PASS
			30~1000	0.23	-52.46	≤ -29.77	PASS
			1000~26500	0.23	-37.55	≤ -29.77	PASS
	Ant1	2437	Reference	0.62	0.62	---	PASS
			30~1000	0.62	-52.54	≤ -29.38	PASS
			1000~26500	0.62	-38.24	≤ -29.38	PASS
	Ant0	2462	Reference	0.04	0.04	---	PASS

11AX40MIMO	Ant1	2462	30~1000	0.04	-52.54	≤ -29.96	PASS
			1000~26500	0.04	-38	≤ -29.96	PASS
			Reference	0.03	0.03	---	PASS
			30~1000	0.03	-52.04	≤ -29.97	PASS
			1000~26500	0.03	-37.1	≤ -29.97	PASS
	Ant0	2422	Reference	-1.75	-1.75	---	PASS
			30~1000	-1.75	-51.51	≤ -31.75	PASS
			1000~26500	-1.75	-38.02	≤ -31.75	PASS
	Ant1	2422	Reference	-3.79	-3.79	---	PASS
			30~1000	-3.79	-52.43	≤ -33.79	PASS
			1000~26500	-3.79	-38.1	≤ -33.79	PASS
	Ant0	2437	Reference	-2.44	-2.44	---	PASS
			30~1000	-2.44	-52.02	≤ -32.44	PASS
			1000~26500	-2.44	-38.06	≤ -32.44	PASS
	Ant1	2437	Reference	-3.29	-3.29	---	PASS
			30~1000	-3.29	-52.95	≤ -33.29	PASS
			1000~26500	-3.29	-37.54	≤ -33.29	PASS
	Ant0	2452	Reference	-1.02	-1.02	---	PASS
			30~1000	-1.02	-52.61	≤ -31.02	PASS
			1000~26500	-1.02	-38.28	≤ -31.02	PASS
	Ant1	2452	Reference	-3.04	-3.04	---	PASS
			30~1000	-3.04	-52.79	≤ -33.04	PASS
			1000~26500	-3.04	-36.74	≤ -33.04	PASS







11B_Ant1_2412_0~Reference



11B_Ant1_2412_30~1000

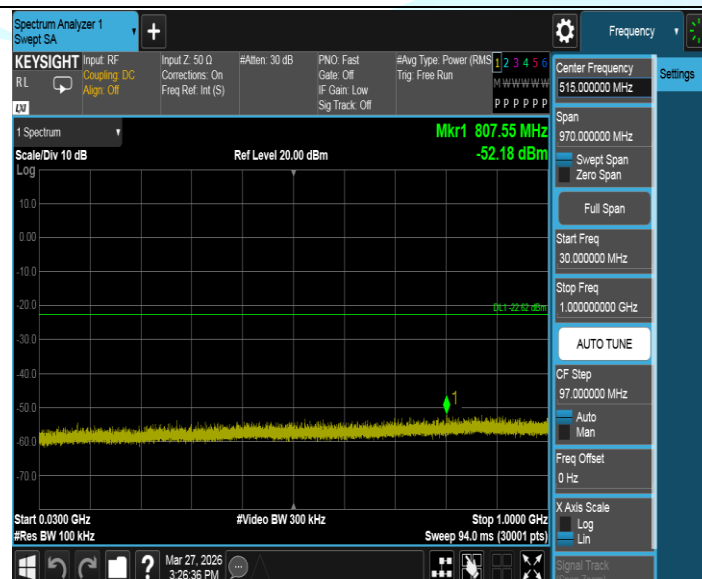

11B_Ant1_2412_1000~26500

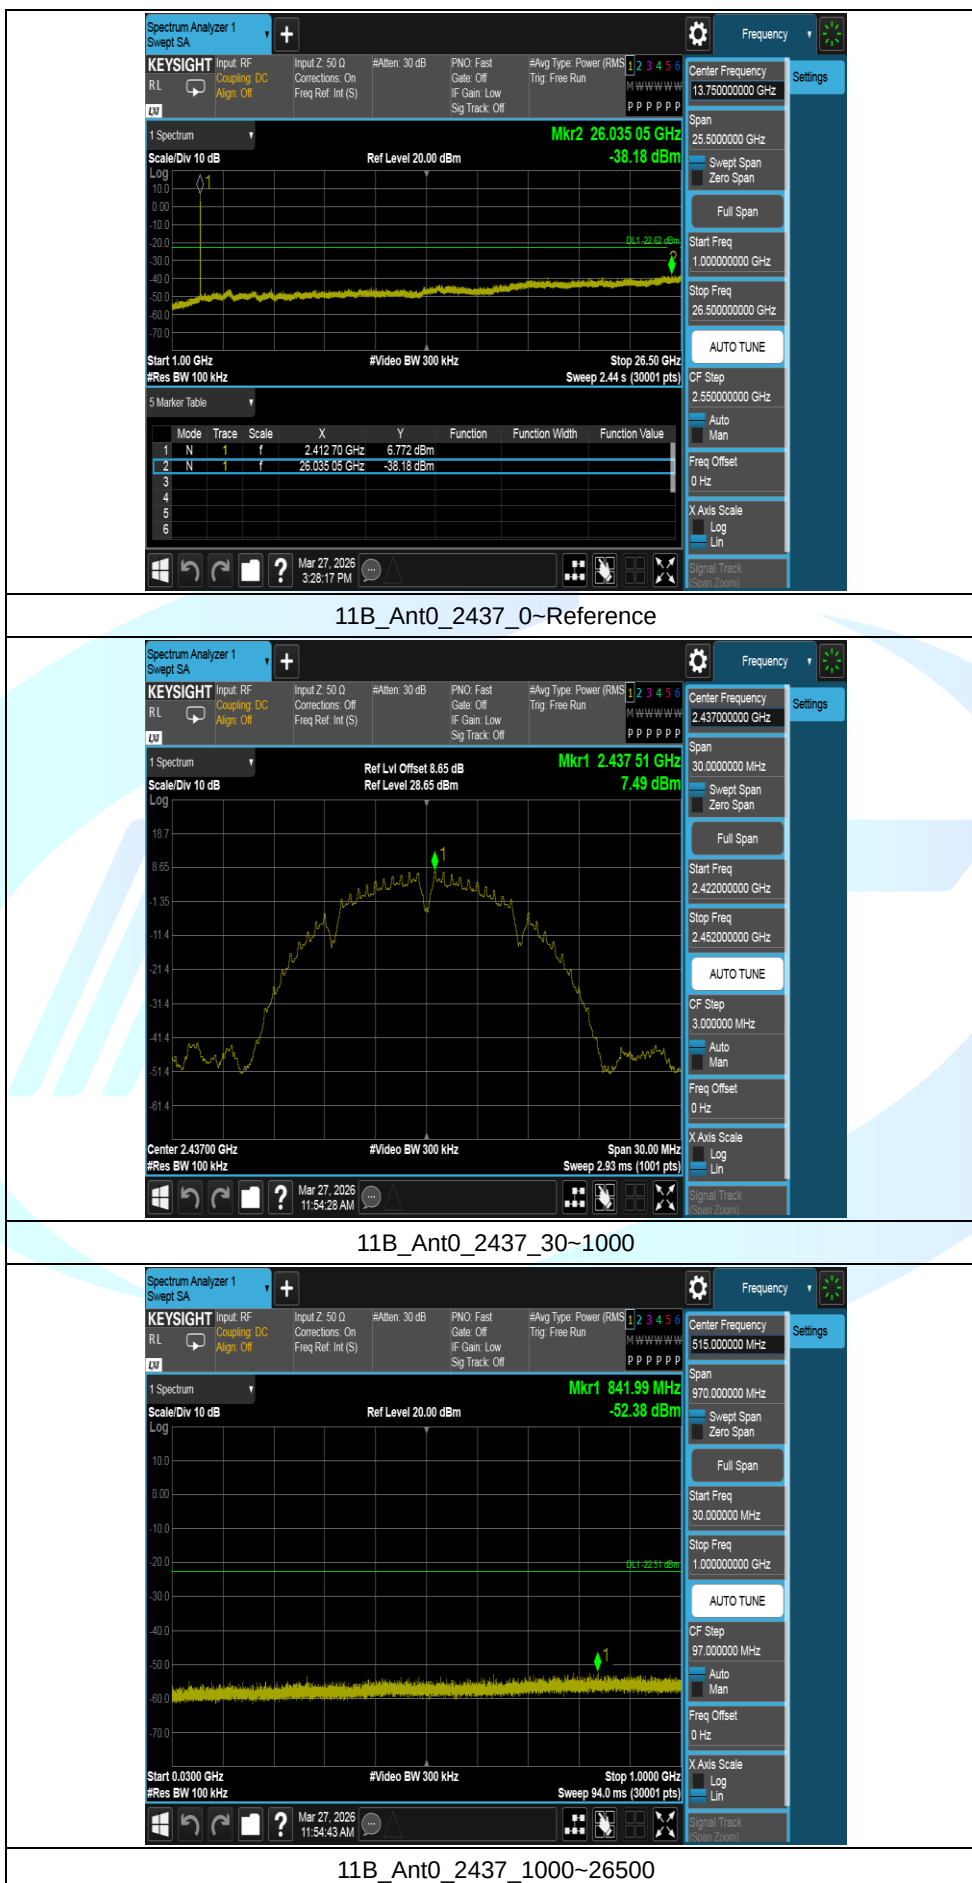




11B_Ant1_2437_0~Reference



11B_Ant1_2437_30~1000

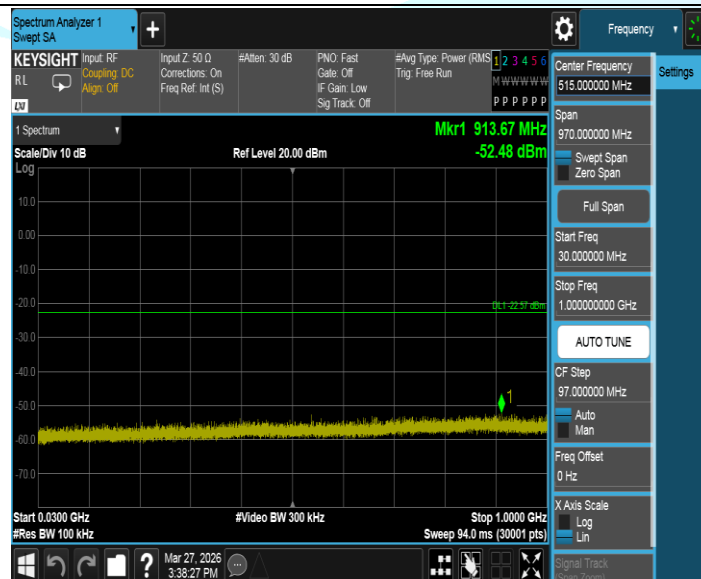


11B_Ant1_2437_1000~26500




11B_Ant0_2462_0~Reference



11B_Ant0_2462_30~1000

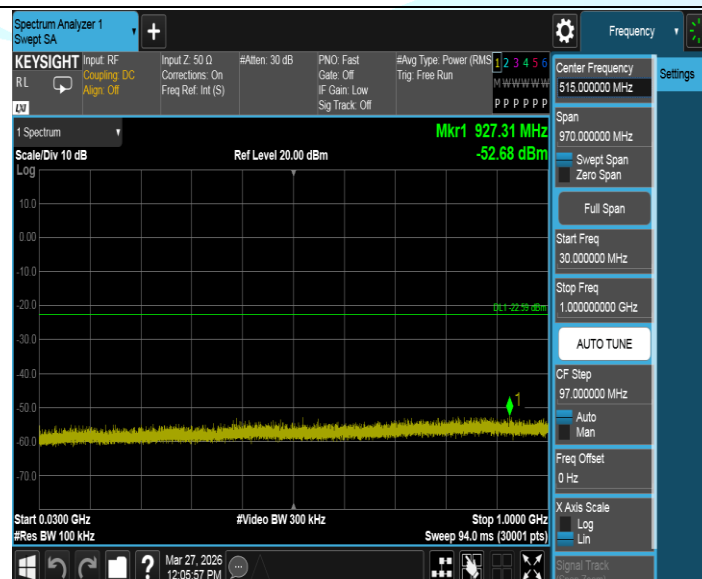

11B_Ant0_2462_1000~26500

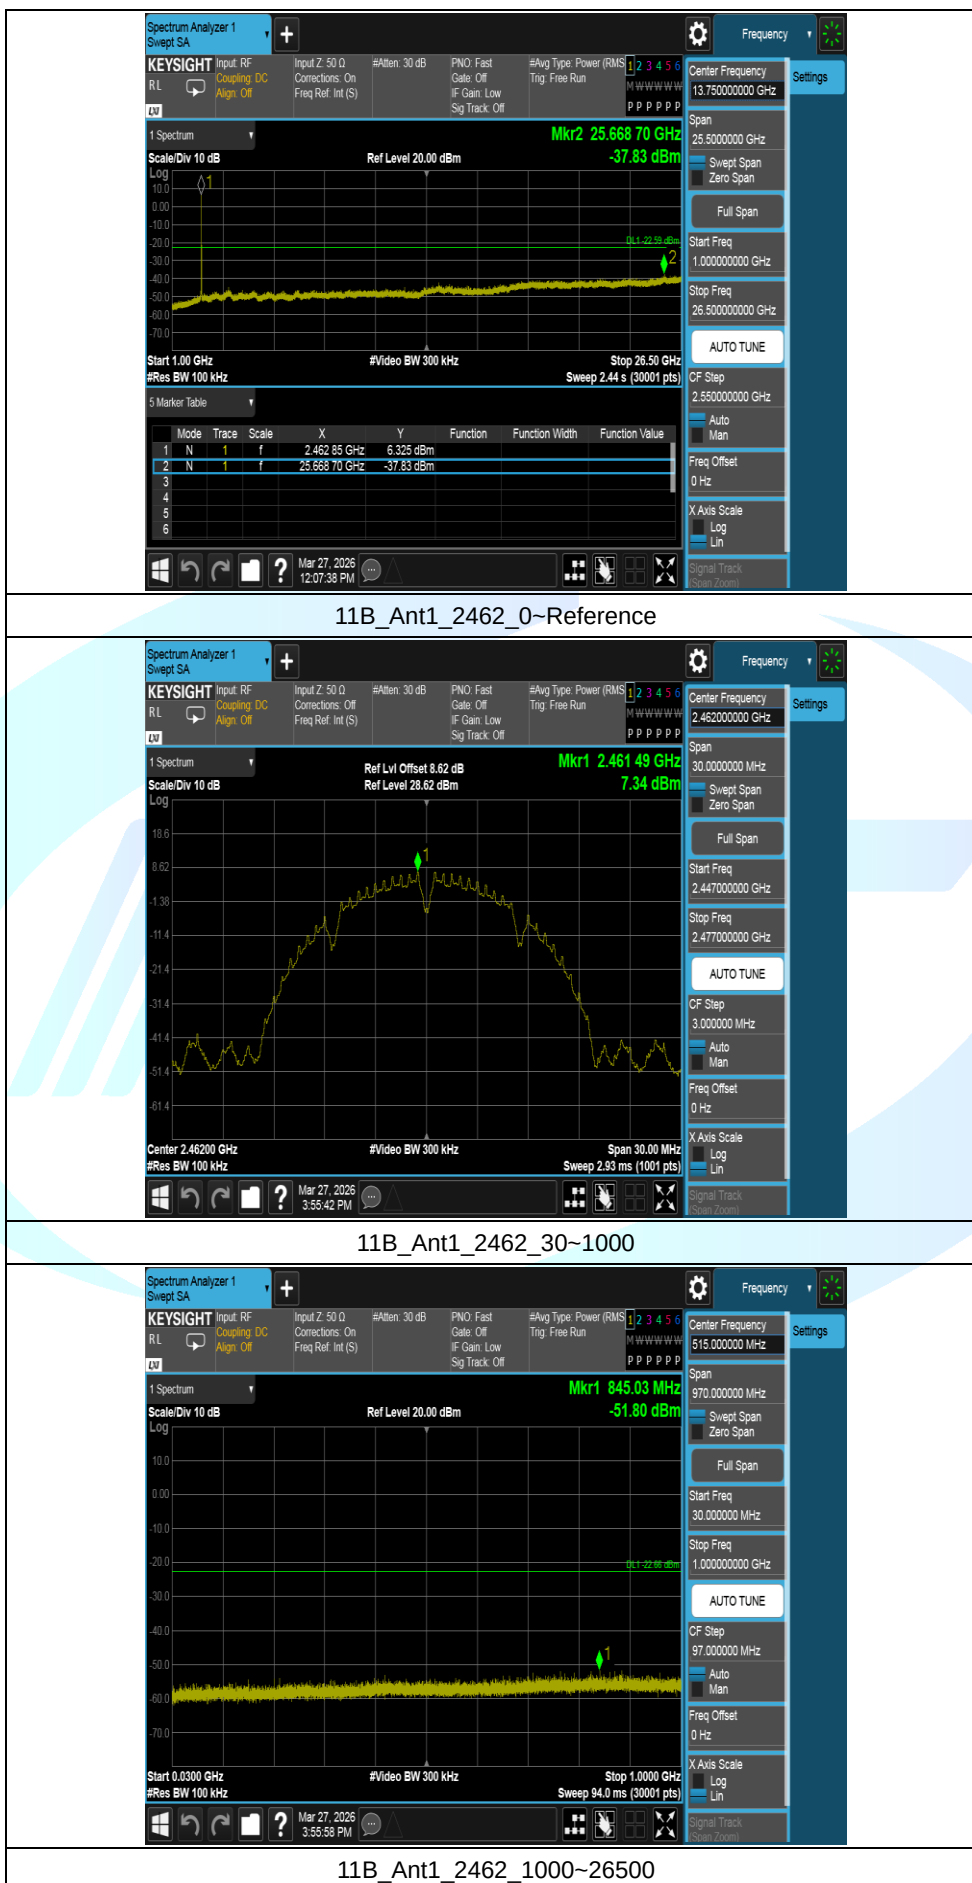




11G_Ant0_2412_0~Reference



11G_Ant0_2412_30~1000

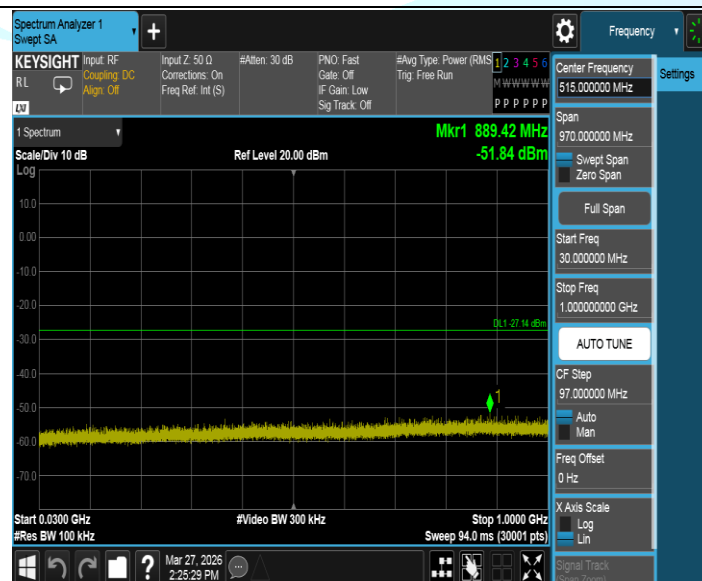


11G_Ant0_2412_1000~26500



11G_Ant1_2412_0~Reference



11G_Ant1_2412_30~1000

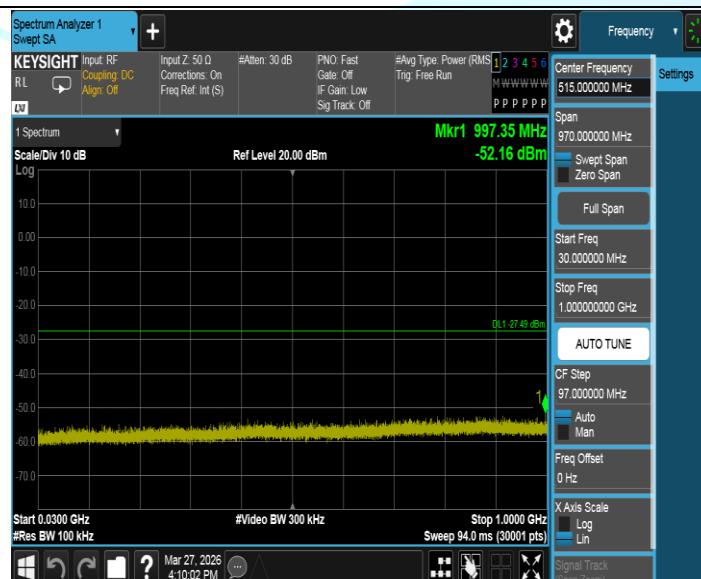


11G_Ant1_2412_1000~26500



11G_Ant0_2437_0~Reference



11G_Ant0_2437_30~1000

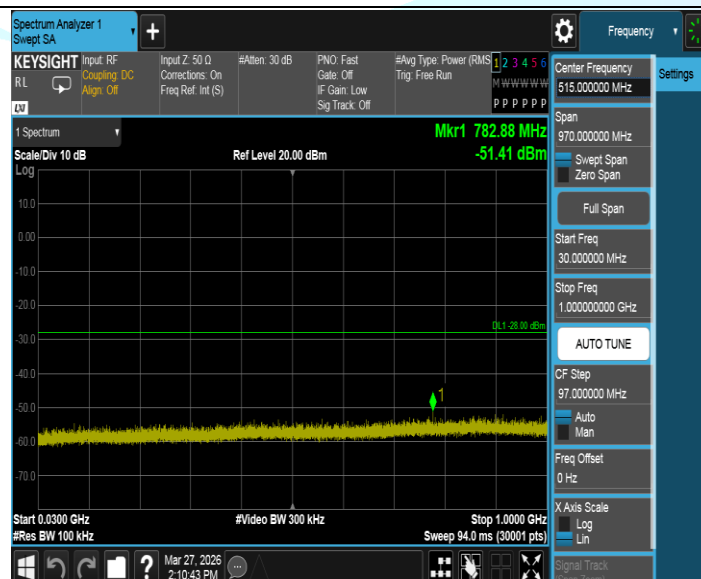


11G_Ant0_2437_1000~26500



11G_Ant1_2437_0~Reference



11G_Ant1_2437_30~1000

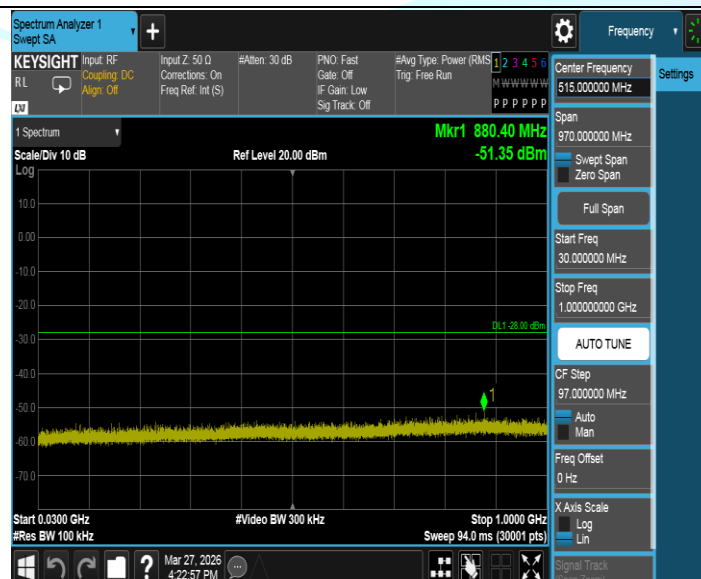


11G_Ant1_2437_1000~26500



11G_Ant0_2462_0~Reference



11G_Ant0_2462_30~1000

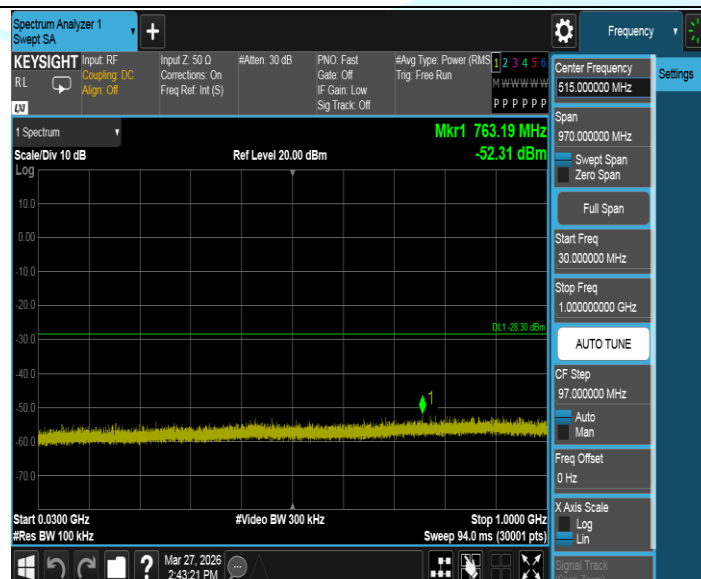


11G_Ant0_2462_1000~26500



11G_Ant1_2462_0~Reference



11G_Ant1_2462_30~1000

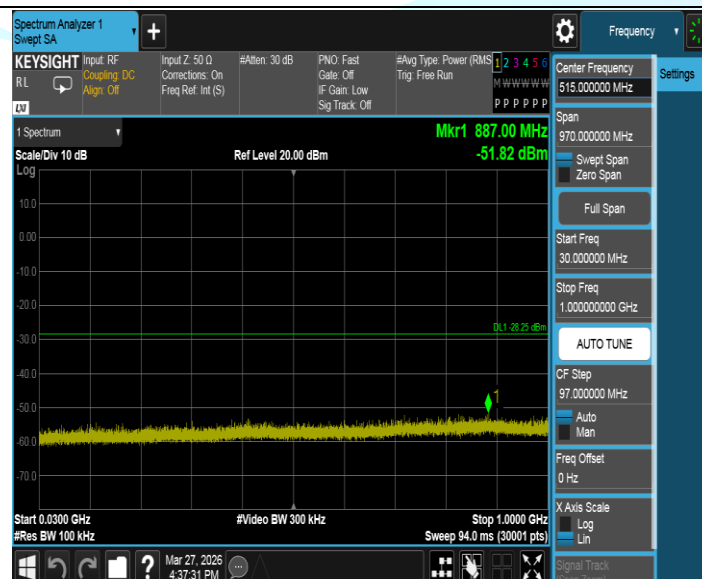

11G_Ant1_2462_1000~26500