


Appendix Test Data

Report No.:	1812C60437412505-01	Test Sample No.:	1-3-2
Start Test Date:	2026-8-27	Finish Test Date:	2026-9-29
Test Engineer:	Tracy Liang	Auditor:	Justin Feng
Temperature:	26.0°C	Relative Humidity:	60%
Pressure:	101kPa		

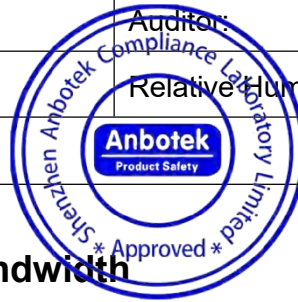

Appendix A1: Emission Bandwidth

Test Result

TestMode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11AX20MIMO	Ant1	5955	23.04	5944.04	5967.08	---	---
11AX20MIMO	Ant2	5955	22.28	5943.76	5966.04	---	---
11AX20MIMO	Ant1	6175	21.72	6163.84	6185.56	---	---
11AX20MIMO	Ant2	6175	22.12	6163.84	6185.96	---	---
11AX20MIMO	Ant1	6415	22.32	6404.00	6426.32	---	---
11AX20MIMO	Ant2	6415	23.84	6402.48	6426.32	---	---
11AX20MIMO	Ant1	6435	21.44	6424.28	6445.72	---	---
11AX20MIMO	Ant2	6435	22.52	6423.36	6445.88	---	---
11AX20MIMO	Ant1	6475	21.60	6464.16	6485.76	---	---
11AX20MIMO	Ant2	6475	22.00	6464.08	6486.08	---	---
11AX20MIMO	Ant1	6515	23.00	6503.28	6526.28	---	---
11AX20MIMO	Ant2	6515	21.40	6504.36	6525.76	---	---
11AX20MIMO	Ant1	6535	22.60	6523.20	6545.80	---	---
11AX20MIMO	Ant2	6535	21.56	6524.12	6545.68	---	---
11AX20MIMO	Ant1	6695	21.72	6684.12	6705.84	---	---
11AX20MIMO	Ant2	6695	21.48	6684.12	6705.60	---	---
11AX20MIMO	Ant1	6855	21.60	6844.28	6865.88	---	---
11AX20MIMO	Ant2	6855	21.44	6844.28	6865.72	---	---
11AX20MIMO	Ant1	6875	21.56	6864.32	6885.88	---	---
11AX20MIMO	Ant2	6875	21.64	6864.16	6885.80	---	---
11AX20MIMO	Ant1	6895	21.64	6884.28	6905.92	---	---
11AX20MIMO	Ant2	6895	21.84	6883.88	6905.72	---	---
11AX20MIMO	Ant1	6995	23.40	6983.16	7006.56	---	---
11AX20MIMO	Ant2	6995	25.84	6982.80	7008.64	---	---
11AX20MIMO	Ant1	7115	23.32	7103.12	7126.44	---	---
11AX20MIMO	Ant2	7115	25.76	7101.28	7127.04	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX40MIMO	Ant1	5965	40.88	5944.68	5985.56	---	---
11AX40MIMO	Ant2	5965	40.96	5944.36	5985.32	---	---
11AX40MIMO	Ant1	6165	41.36	6143.88	6185.24	---	---
11AX40MIMO	Ant2	6165	40.88	6144.68	6185.56	---	---
11AX40MIMO	Ant1	6405	40.56	6384.28	6424.84	---	---
11AX40MIMO	Ant2	6405	42.24	6384.84	6427.08	---	---
11AX40MIMO	Ant1	6445	40.40	6425.08	6465.48	---	---
11AX40MIMO	Ant2	6445	41.68	6423.16	6464.84	---	---
11AX40MIMO	Ant1	6485	40.56	6464.92	6505.48	---	---
11AX40MIMO	Ant2	6485	45.52	6462.84	6508.36	---	---
11AX40MIMO	Ant1	6565	39.84	6544.92	6584.76	---	---
11AX40MIMO	Ant2	6565	40.96	6544.76	6585.72	---	---
11AX40MIMO	Ant1	6685	39.68	6665.16	6704.84	---	---
11AX40MIMO	Ant2	6685	39.68	6665.16	6704.84	---	---
11AX40MIMO	Ant1	6845	39.76	6825.08	6864.84	---	---
11AX40MIMO	Ant2	6845	41.36	6824.04	6865.40	---	---
11AX40MIMO	Ant1	6925	39.76	6905.24	6945.00	---	---
11AX40MIMO	Ant2	6925	40.48	6904.92	6945.40	---	---
11AX40MIMO	Ant1	6965	42.00	6943.88	6985.88	---	---
11AX40MIMO	Ant2	6965	40.64	6944.52	6985.16	---	---
11AX40MIMO	Ant1	7085	41.12	7064.20	7105.32	---	---
11AX40MIMO	Ant2	7085	40.40	7064.52	7104.92	---	---
11AX80MIMO	Ant1	5985	83.36	5944.84	6028.20	---	---
11AX80MIMO	Ant2	5985	82.24	5943.88	6026.12	---	---
11AX80MIMO	Ant1	6145	83.68	6104.84	6188.52	---	---
11AX80MIMO	Ant2	6145	82.08	6104.20	6186.28	---	---
11AX80MIMO	Ant1	6385	84.00	6344.04	6428.04	---	---
11AX80MIMO	Ant2	6385	82.24	6344.04	6426.28	---	---
11AX80MIMO	Ant1	6465	88.96	6424.84	6513.80	---	---
11AX80MIMO	Ant2	6465	83.20	6423.08	6506.28	---	---
11AX80MIMO	Ant1	6545	82.08	6503.88	6585.96	---	---
11AX80MIMO	Ant2	6545	82.08	6503.88	6585.96	---	---
11AX80MIMO	Ant1	6625	82.24	6584.68	6666.92	---	---
11AX80MIMO	Ant2	6625	81.76	6583.88	6665.64	---	---
11AX80MIMO	Ant1	6705	83.04	6664.84	6747.88	---	---
11AX80MIMO	Ant2	6705	82.40	6663.56	6745.96	---	---
11AX80MIMO	Ant1	6785	81.44	6744.68	6826.12	---	---
11AX80MIMO	Ant2	6785	82.24	6743.88	6826.12	---	---
11AX80MIMO	Ant1	6865	81.92	6824.04	6905.96	---	---
11AX80MIMO	Ant2	6865	82.08	6824.04	6906.12	---	---
11AX80MIMO	Ant1	6945	81.12	6904.84	6985.96	---	---
11AX80MIMO	Ant2	6945	81.92	6903.88	6985.80	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AX80MIMO	Ant1	7025	82.40	6984.36	7066.76	---	---
11AX80MIMO	Ant2	7025	81.60	6984.04	7065.64	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

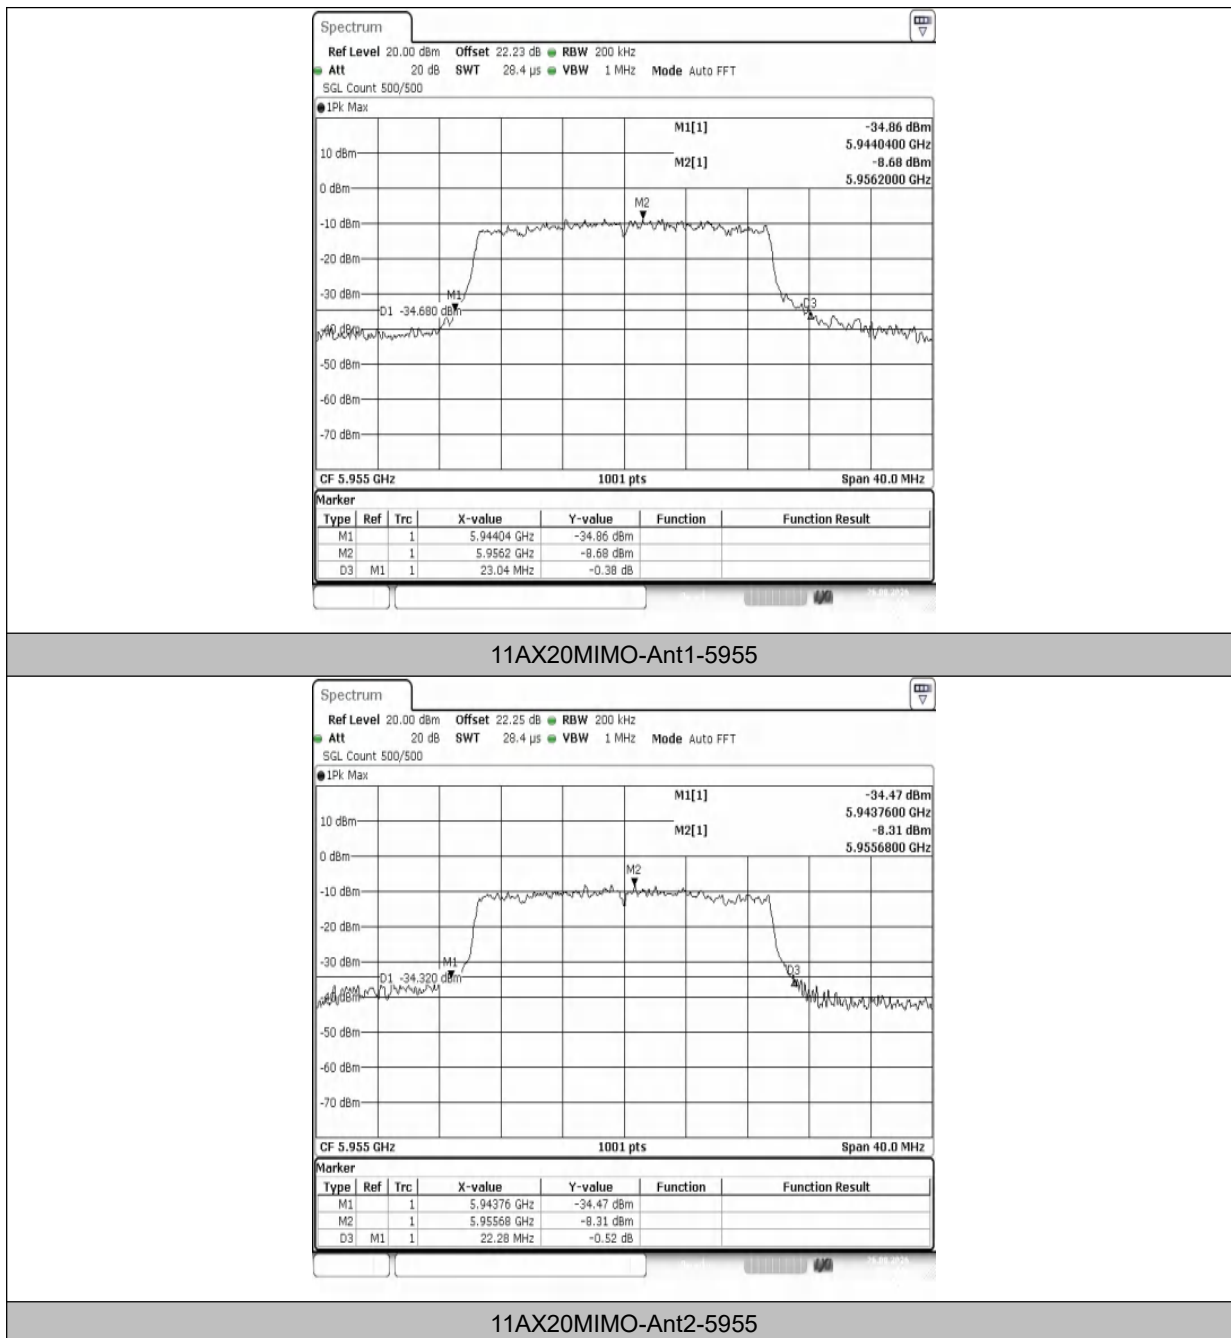



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

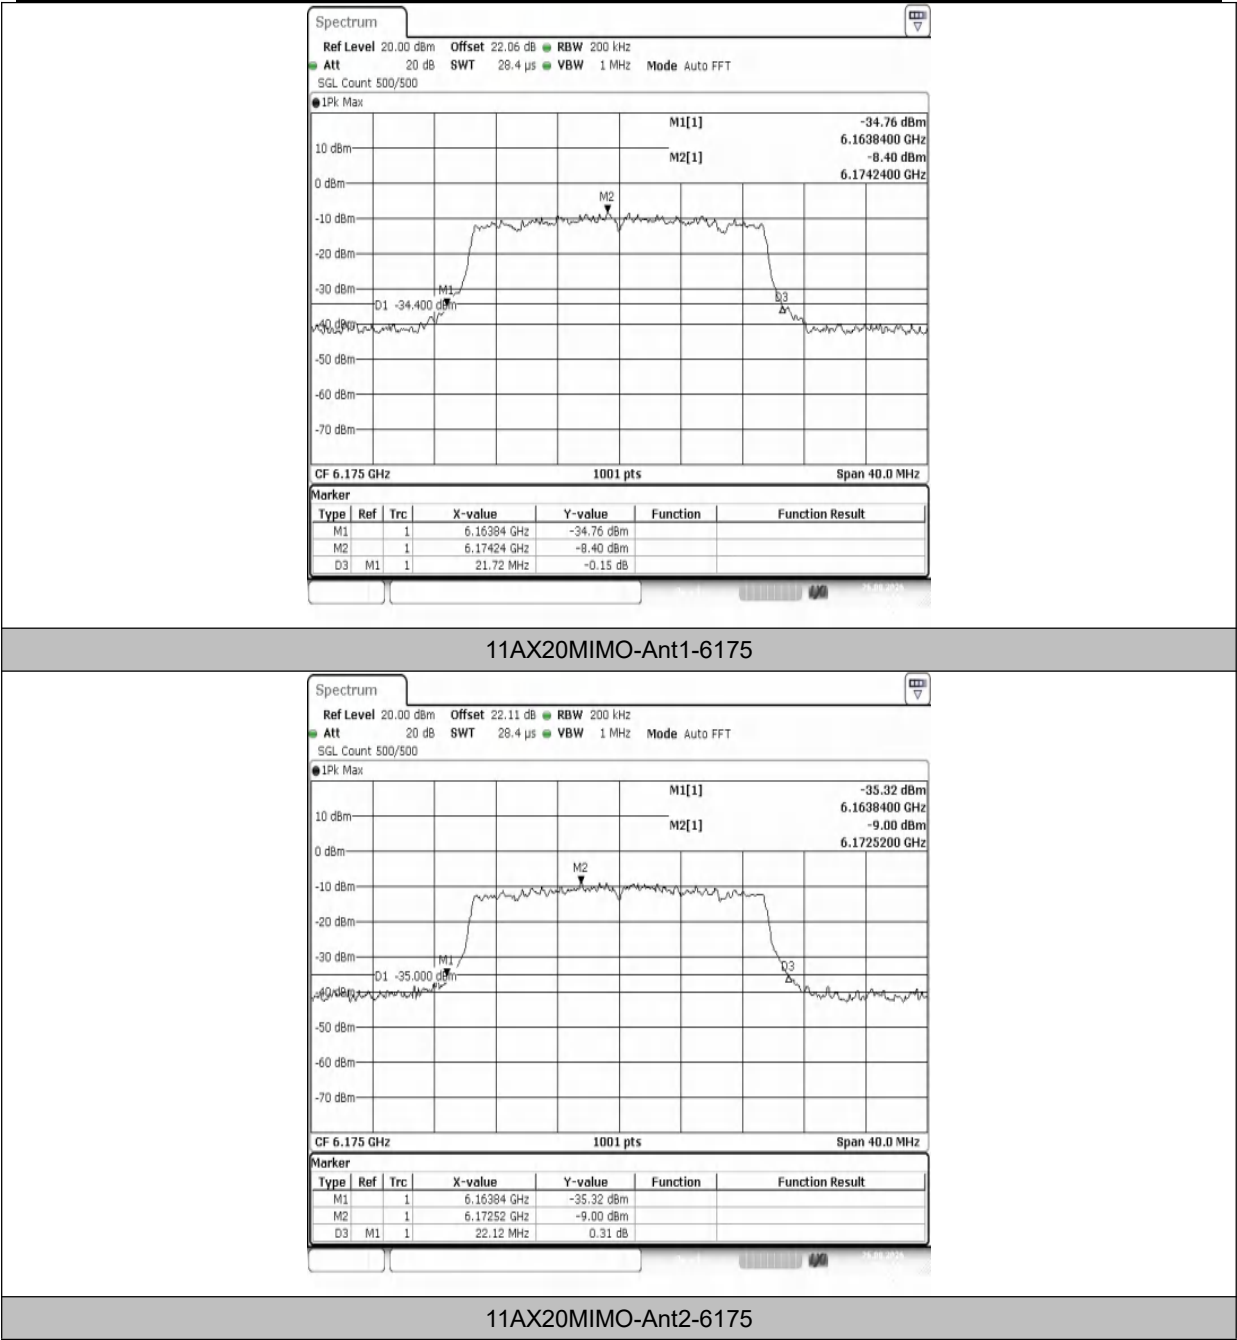

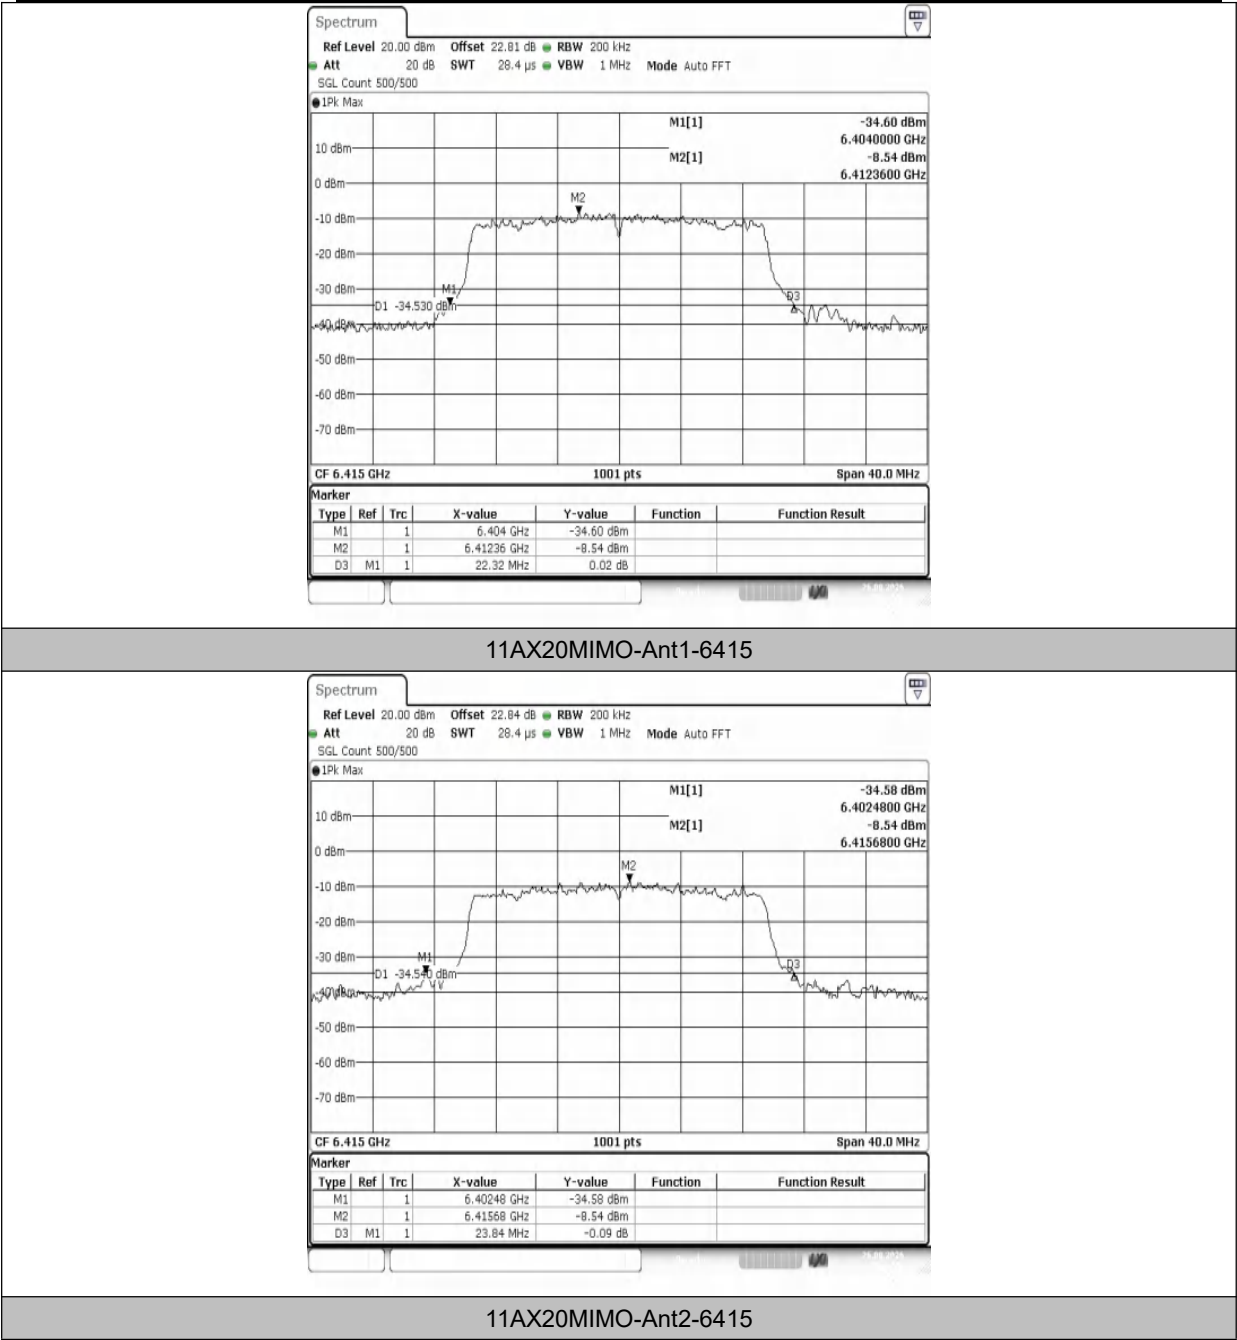

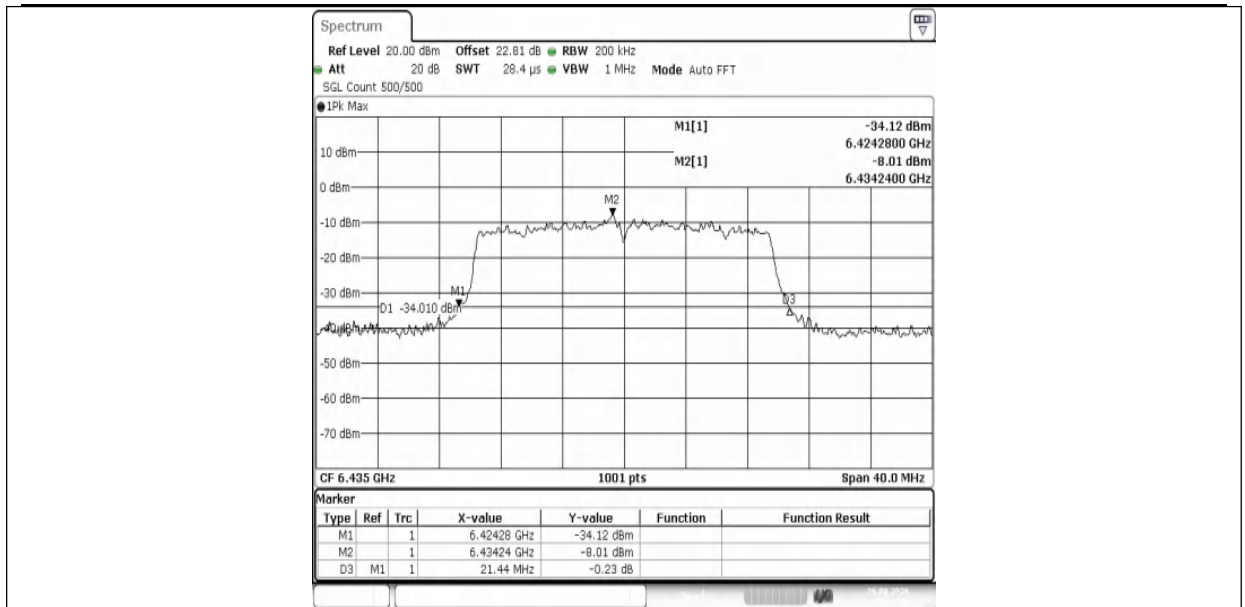

11AX20MIMO-Ant1-6435

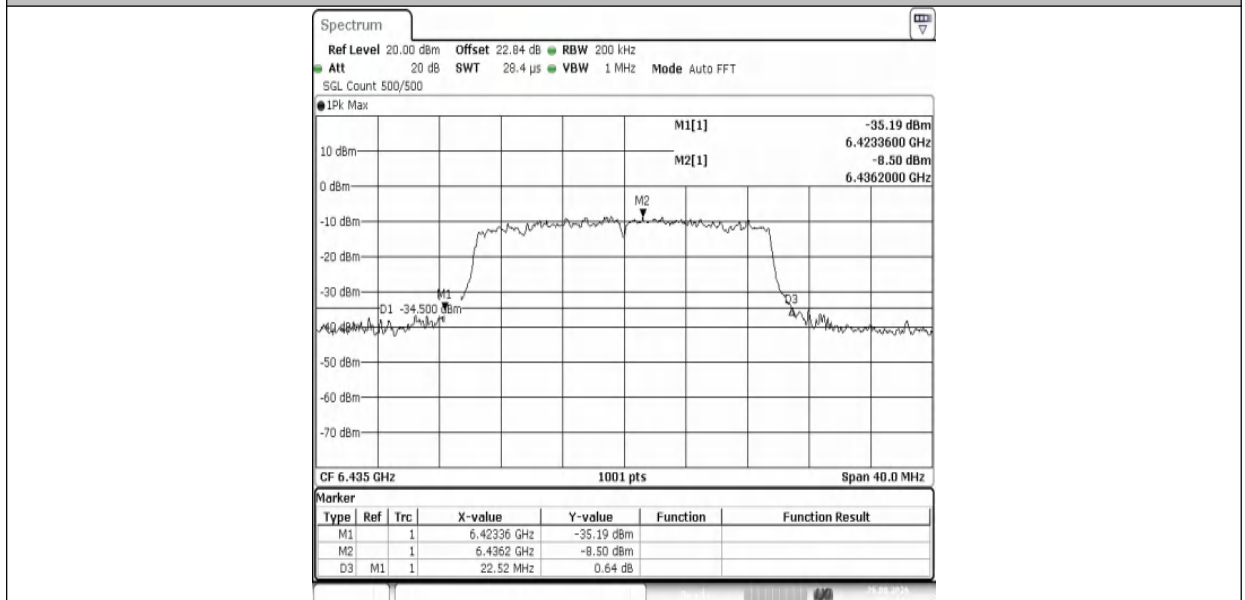



11AX20MIMO-Ant2-6435

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

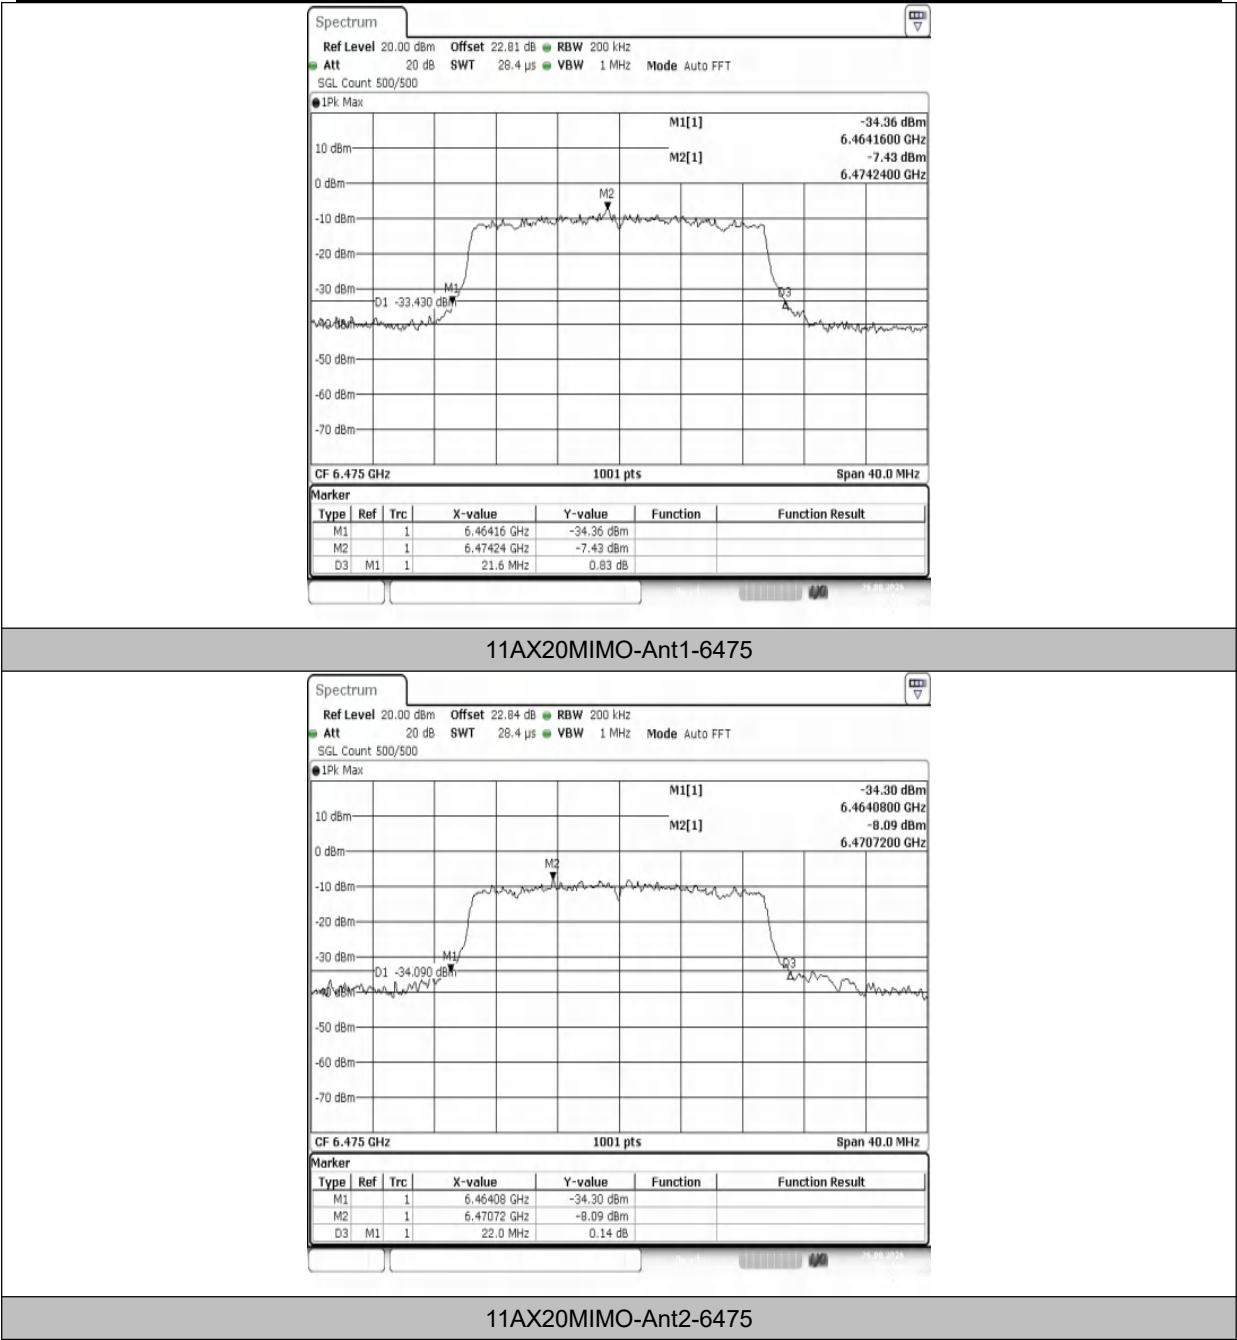

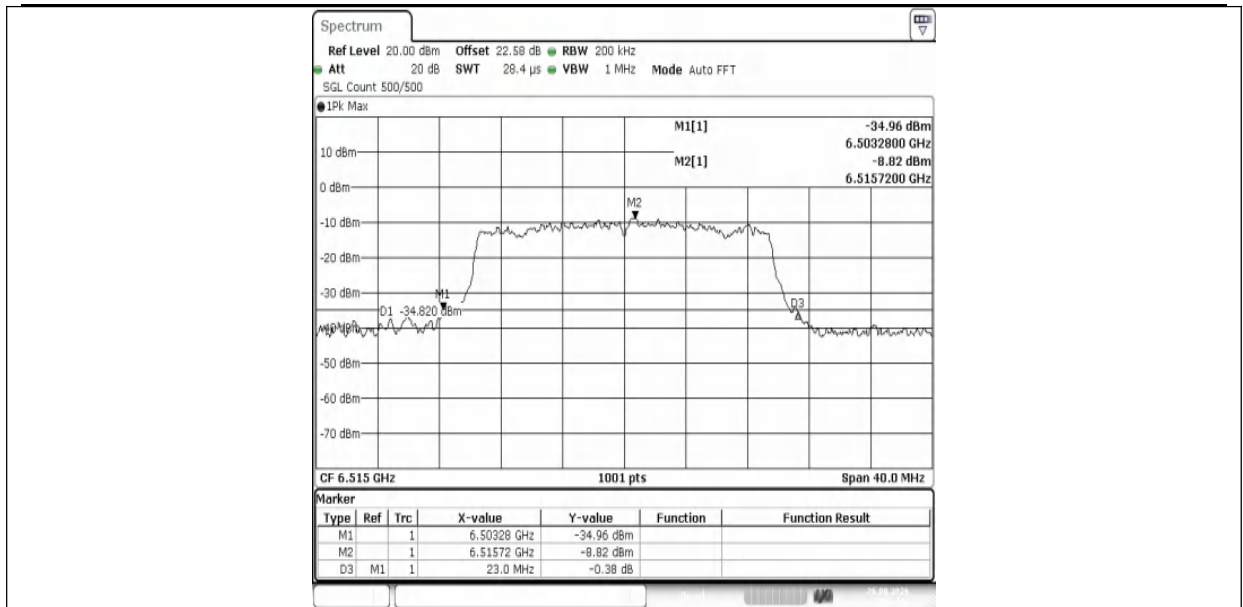

11AX20MIMO-Ant1-6515

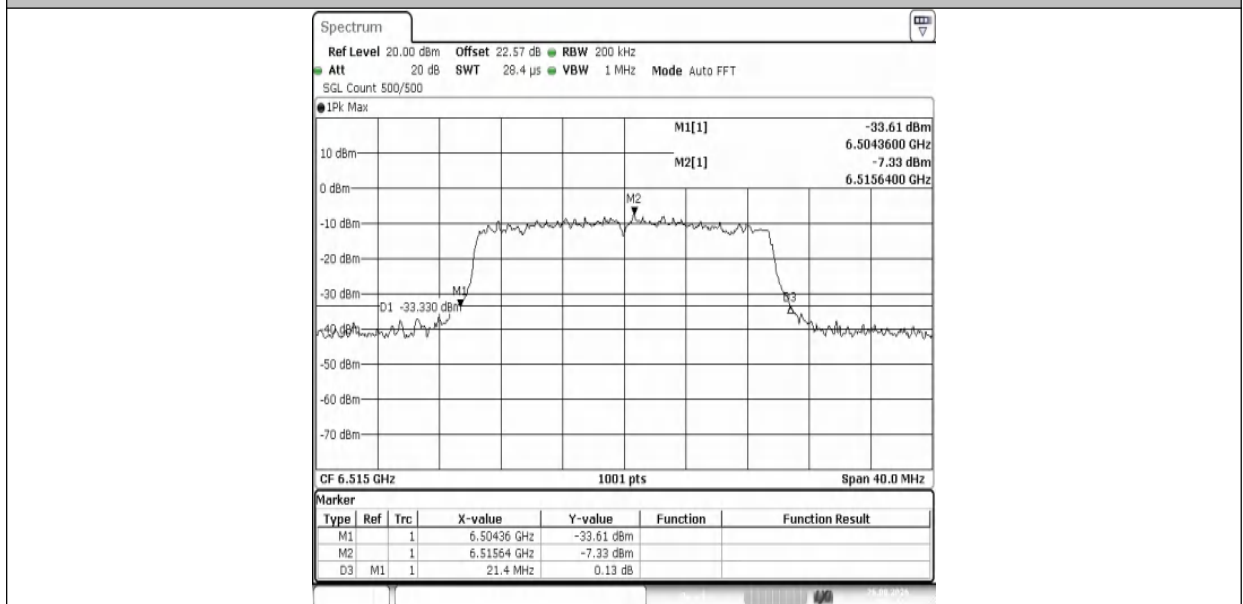


11AX20MIMO-Ant2-6515


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

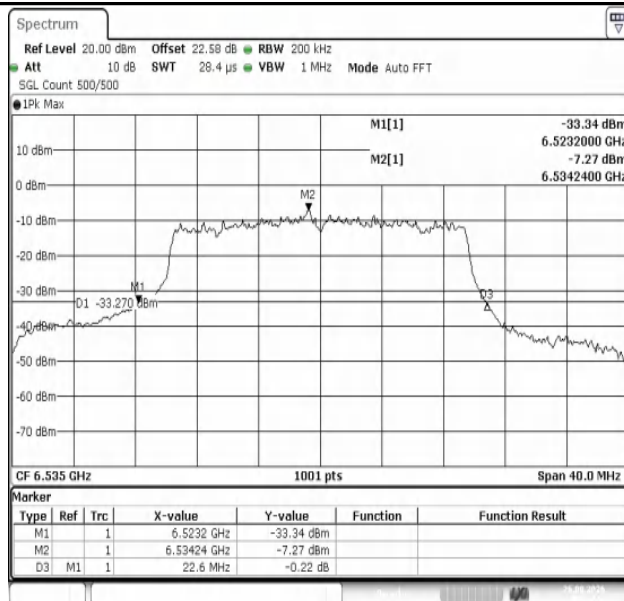

11AX20MIMO-Ant1-6535

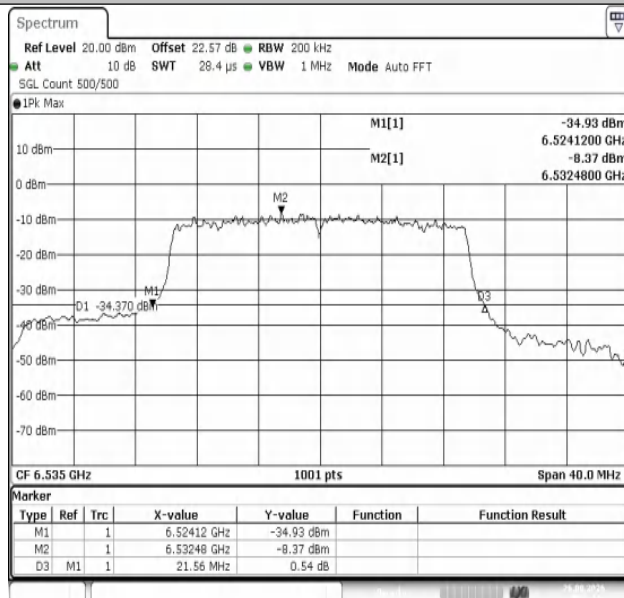



11AX20MIMO-Ant2-6535

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

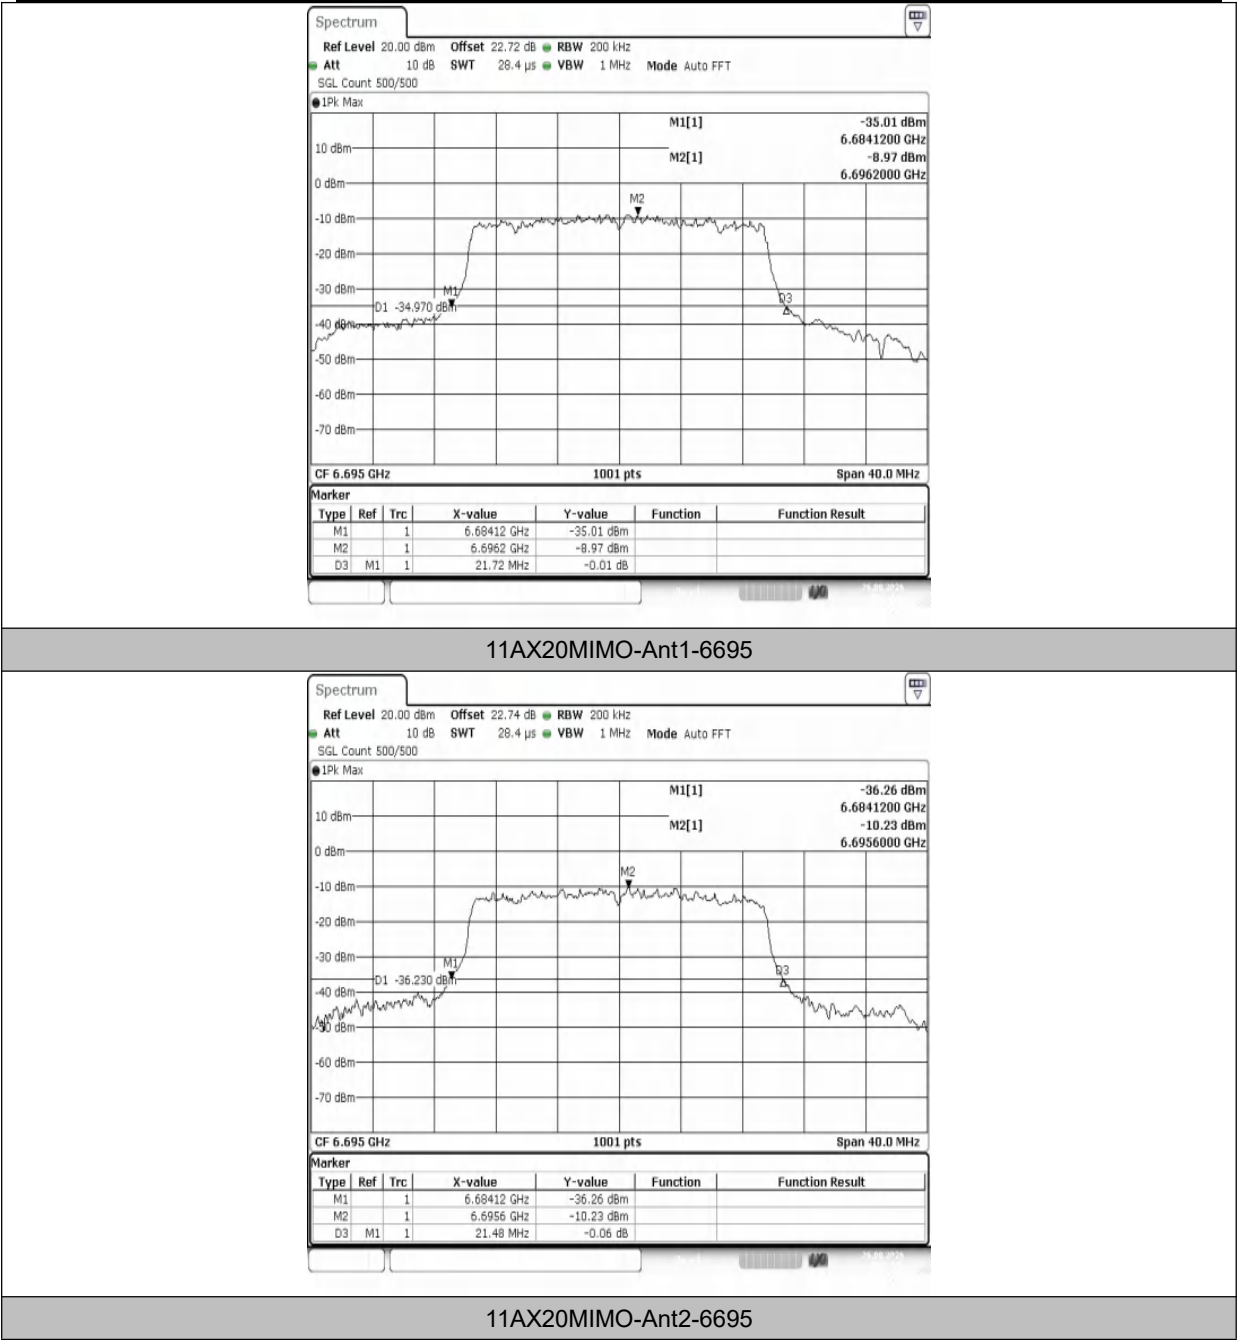

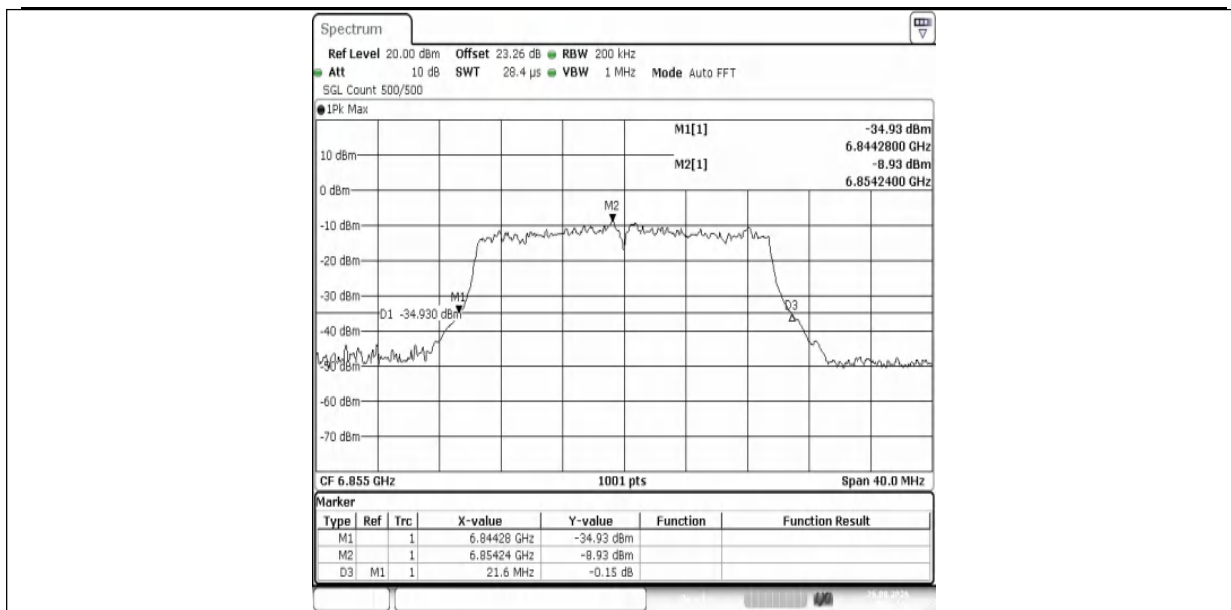

11AX20MIMO-Ant1-6855

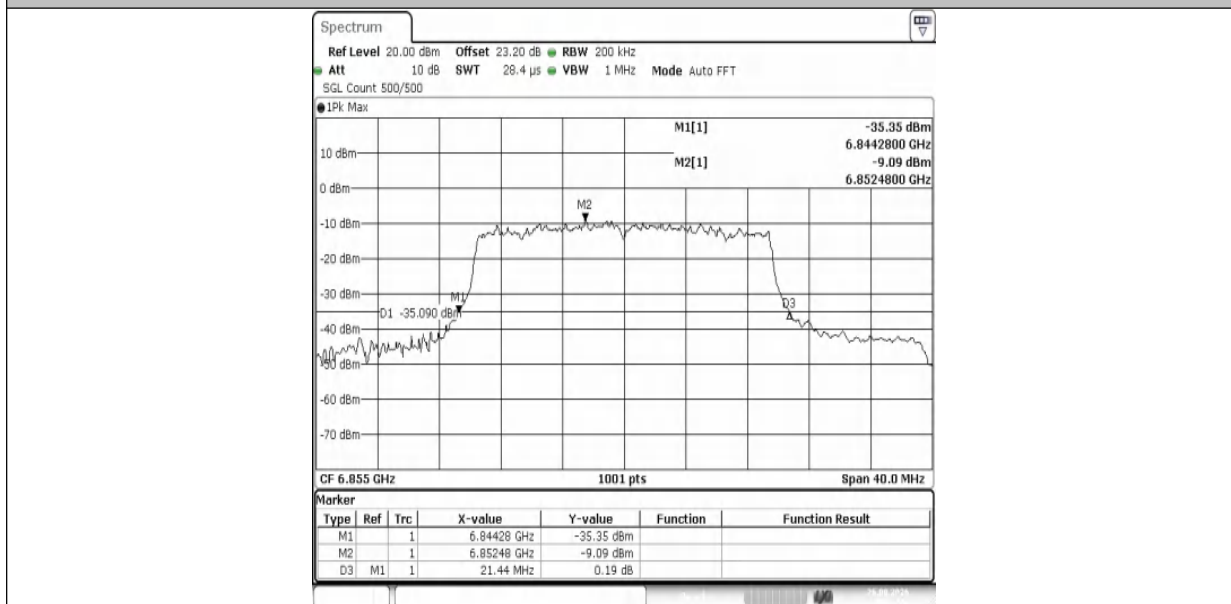


11AX20MIMO-Ant2-6855


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

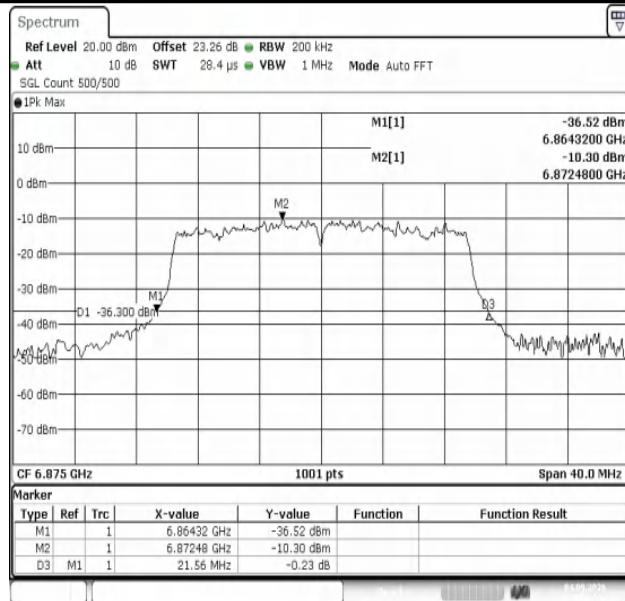

11AX20MIMO-Ant1-6875

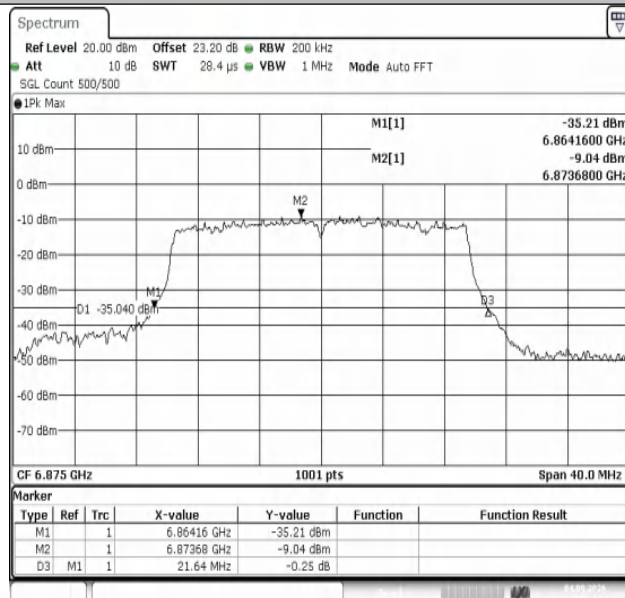


11AX20MIMO-Ant2-6875


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

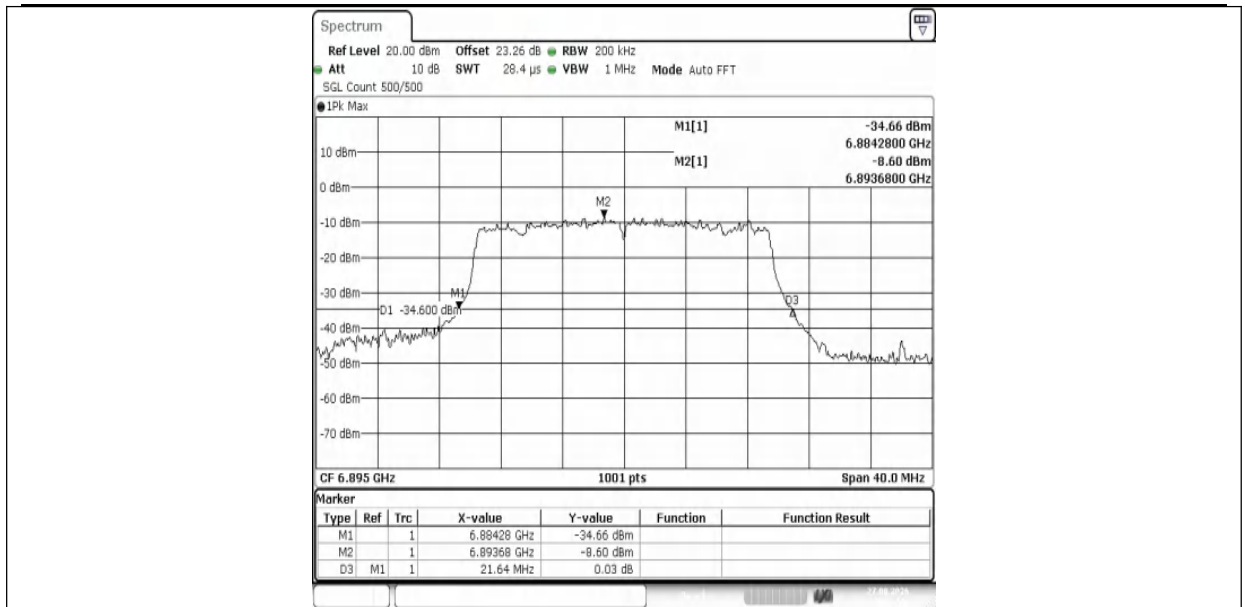

11AX20MIMO-Ant1-6895

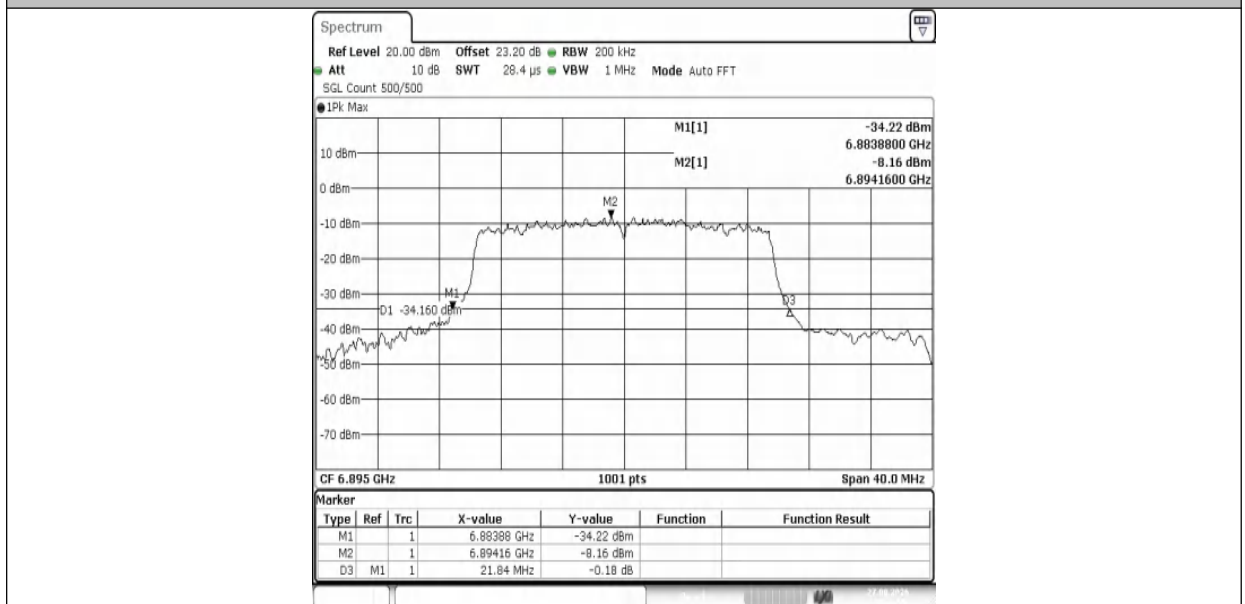


11AX20MIMO-Ant2-6895


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

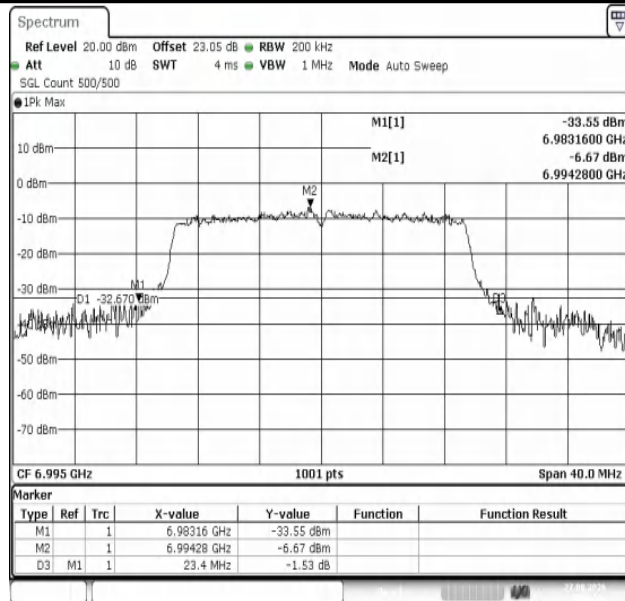


11AX20MIMO-Ant1-6995

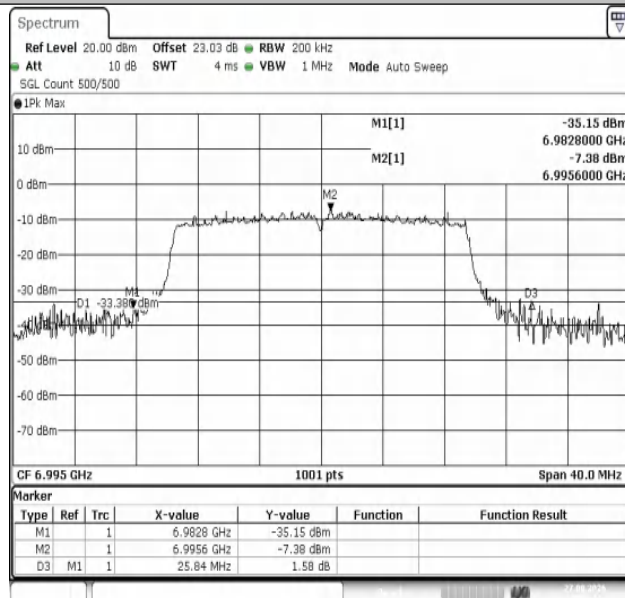

11AX20MIMO-Ant2-6995

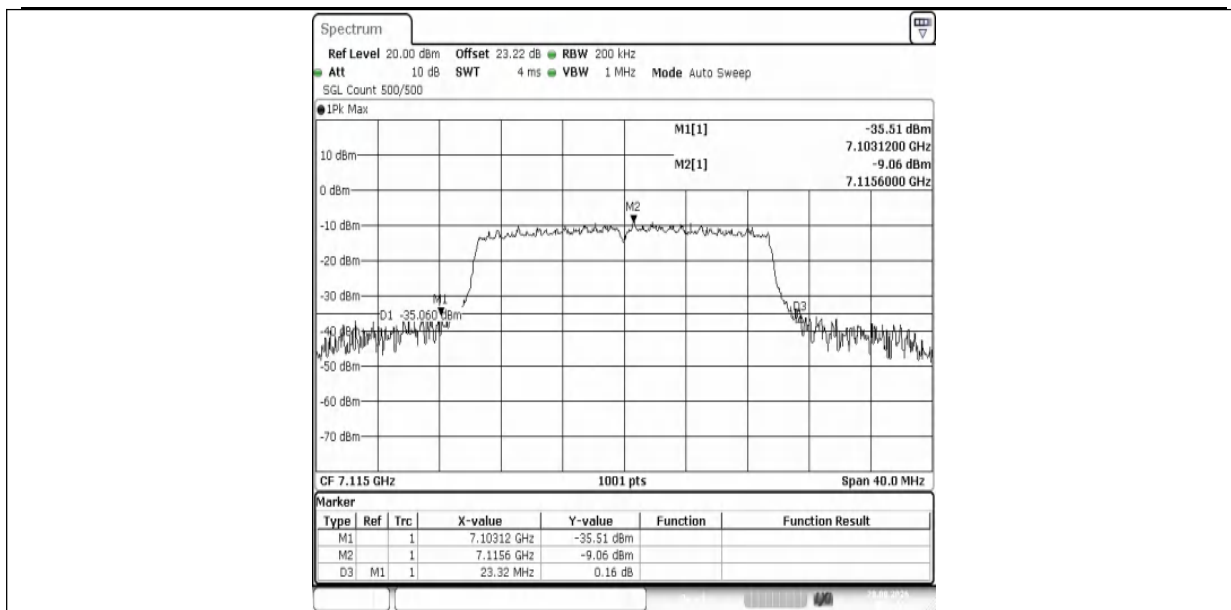

11AX20MIMO-Ant1-7115

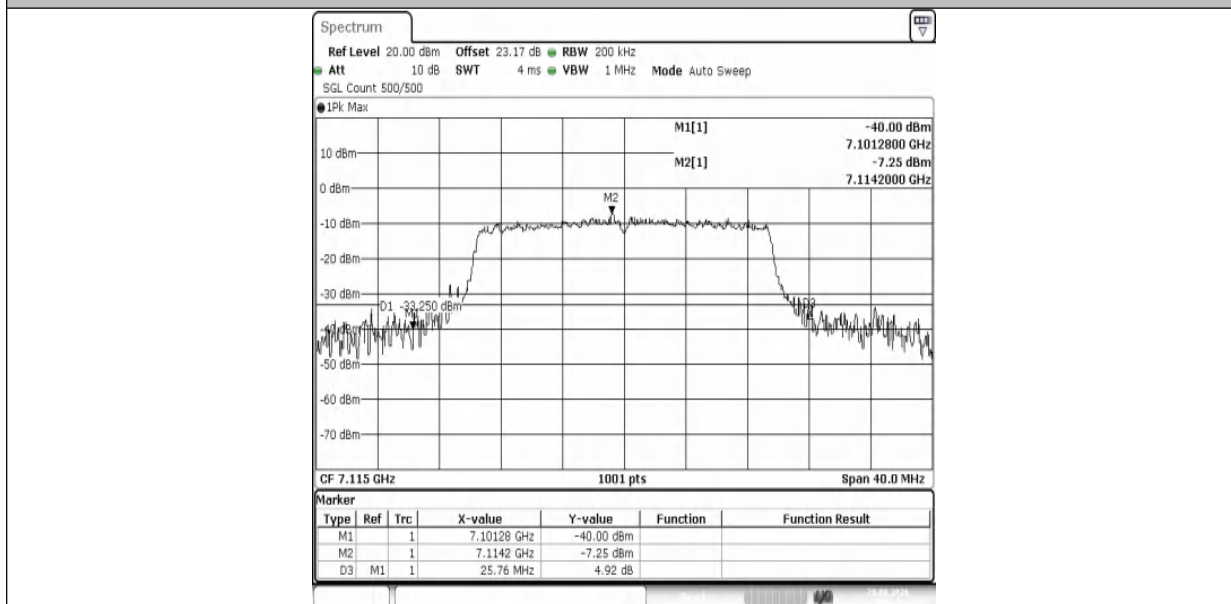


11AX20MIMO-Ant2-7115


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

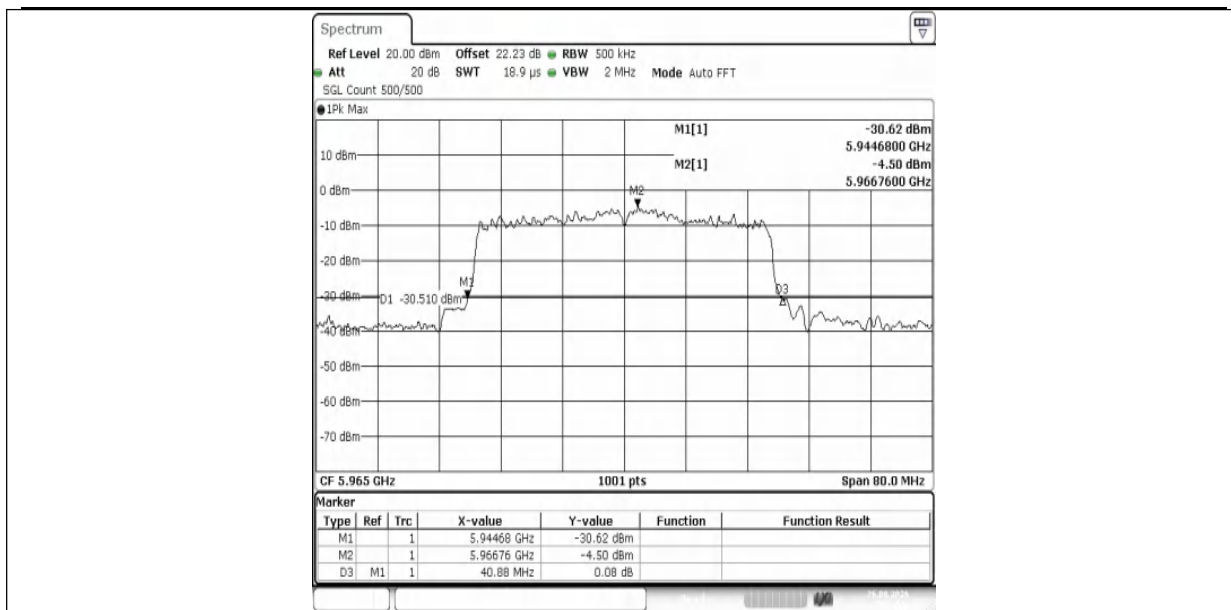

11AX40MIMO-Ant1-5965

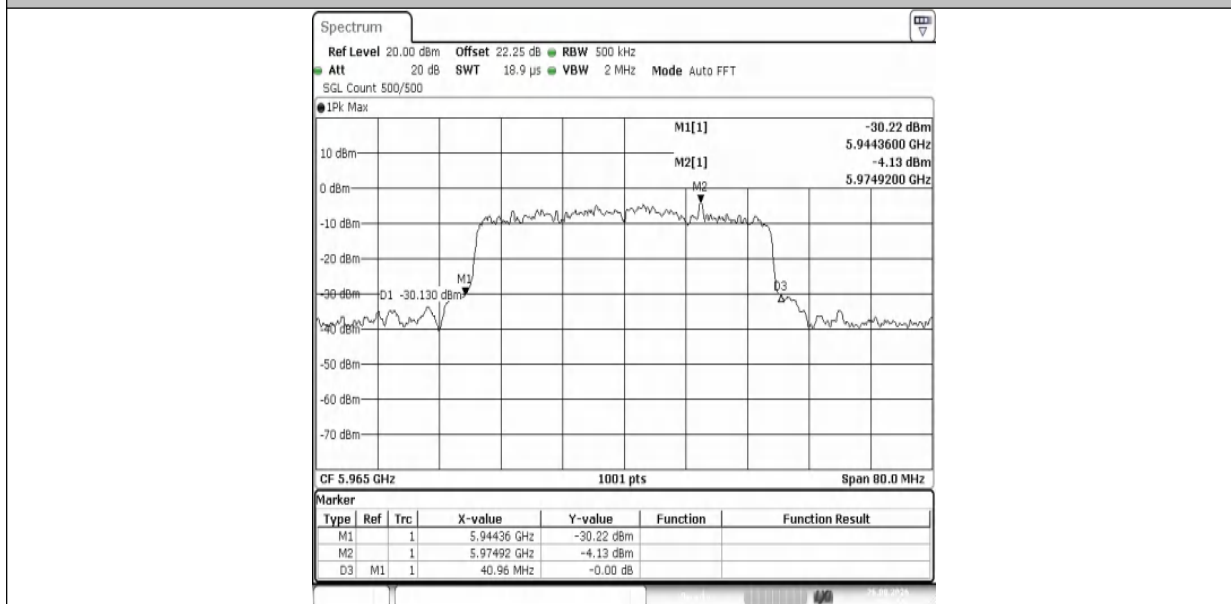


11AX40MIMO-Ant2-5965


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

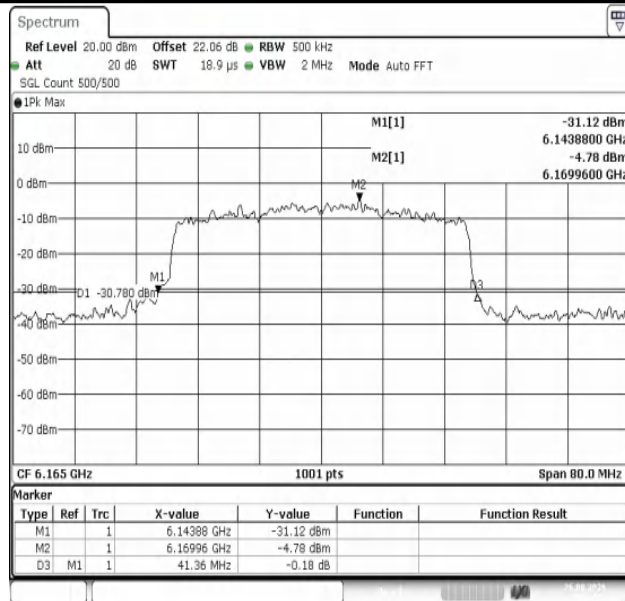

11AX40MIMO-Ant1-6165

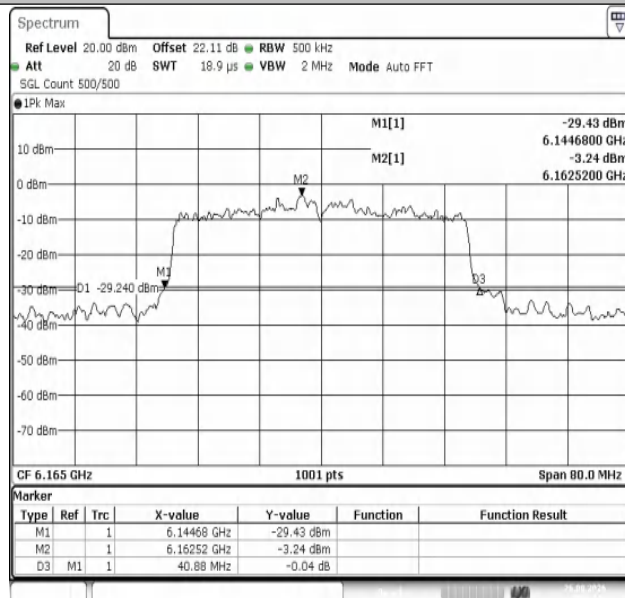


11AX40MIMO-Ant2-6165


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

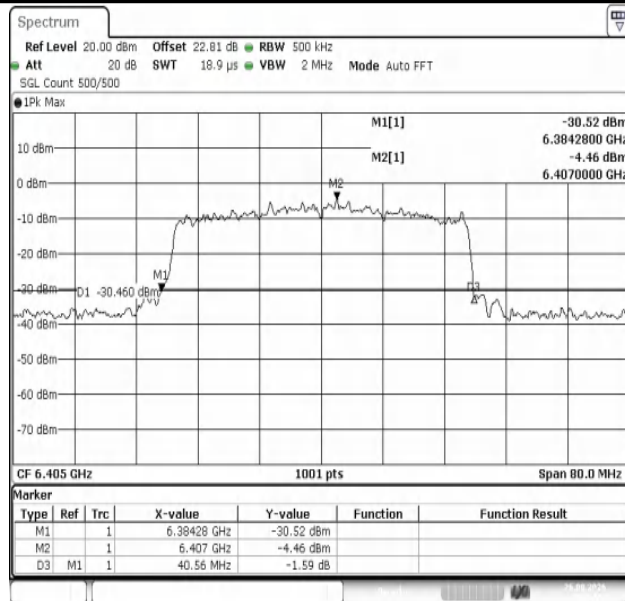


11AX40MIMO-Ant1-6405

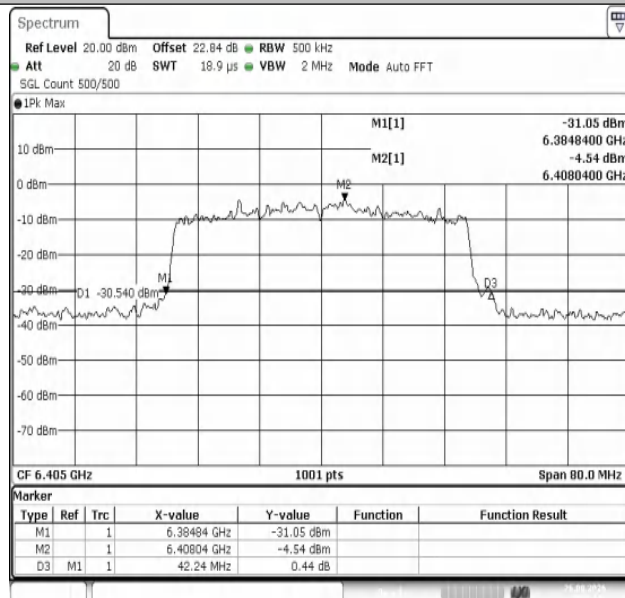


11AX40MIMO-Ant2-6405

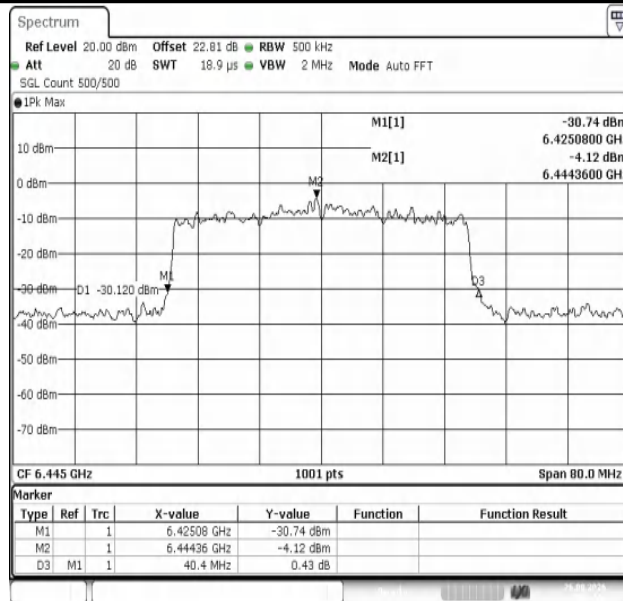


11AX40MIMO-Ant1-6445

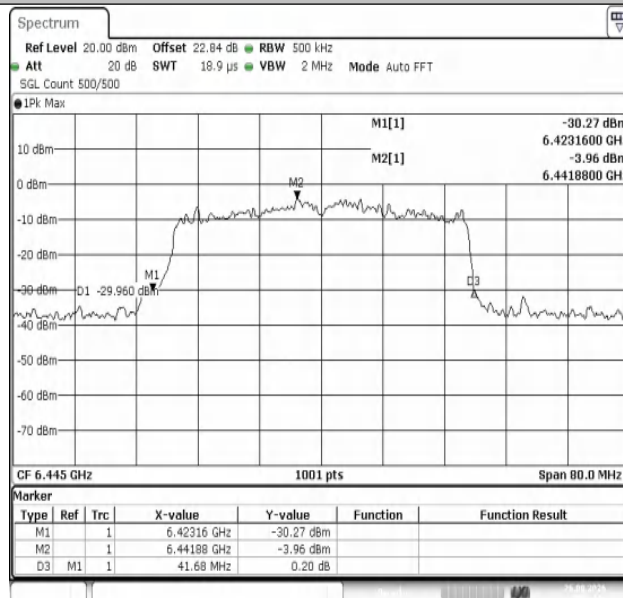


11AX40MIMO-Ant2-6445

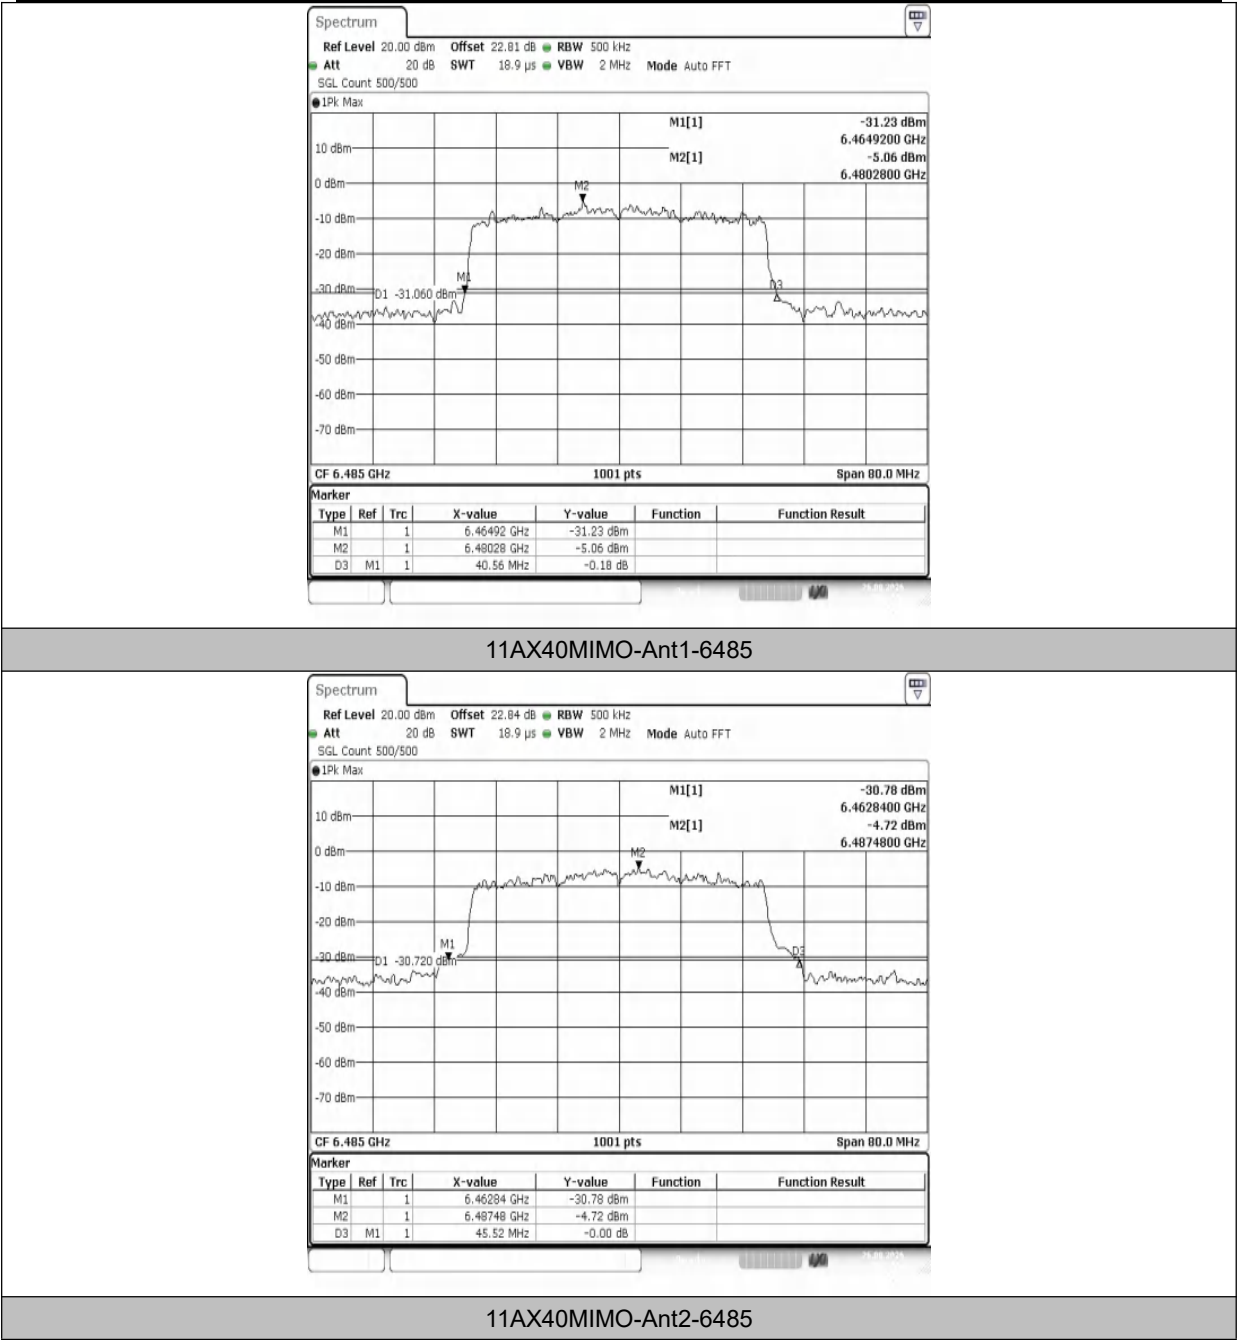


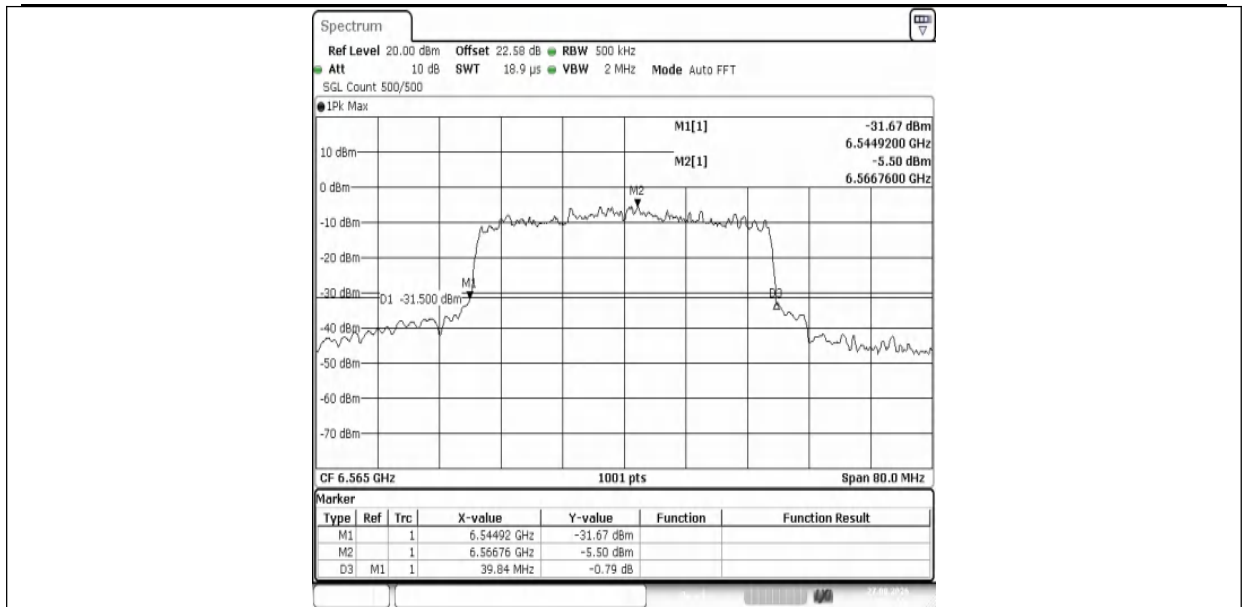


11AX40MIMO-Ant1-6565

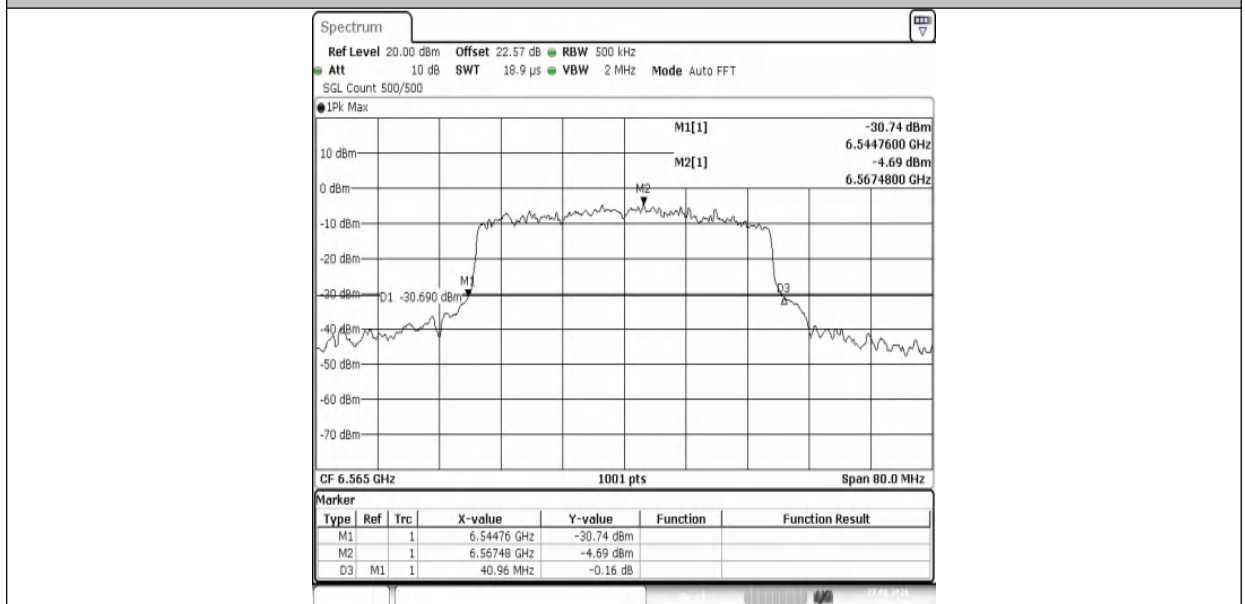

11AX40MIMO-Ant2-6565

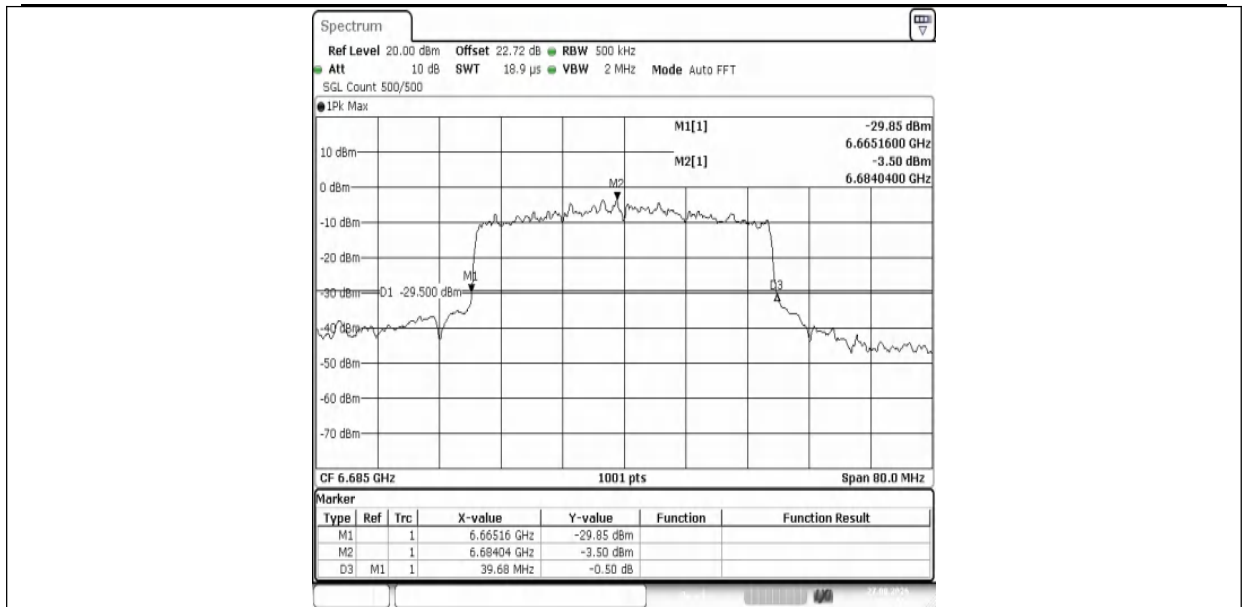

11AX40MIMO-Ant1-6685

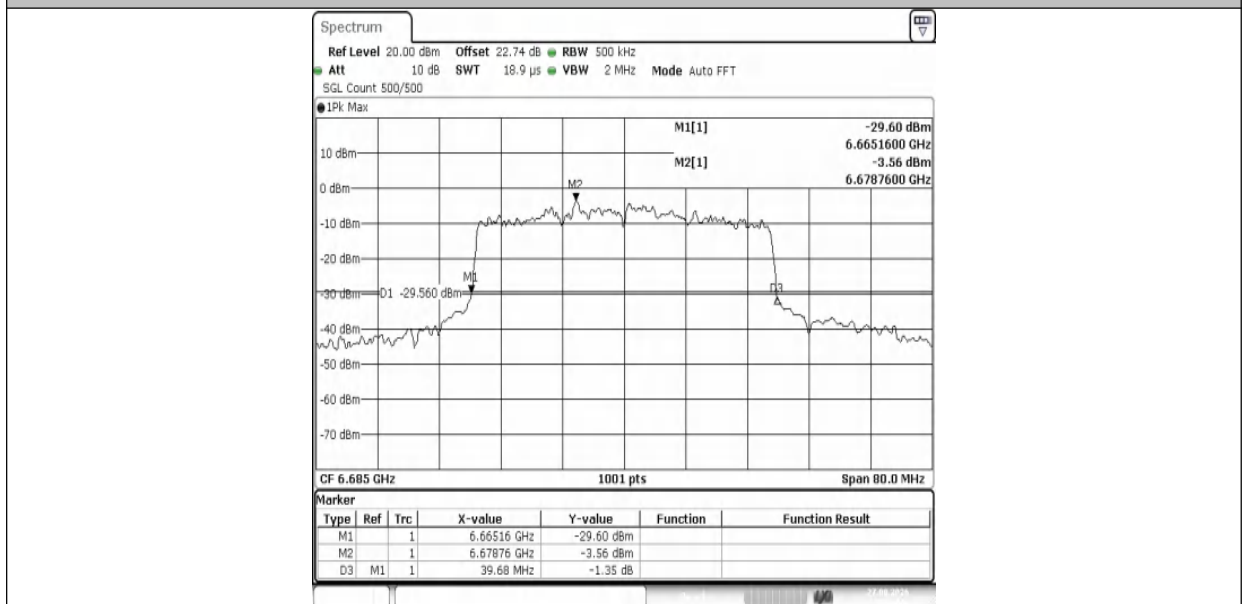


11AX40MIMO-Ant2-6685


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

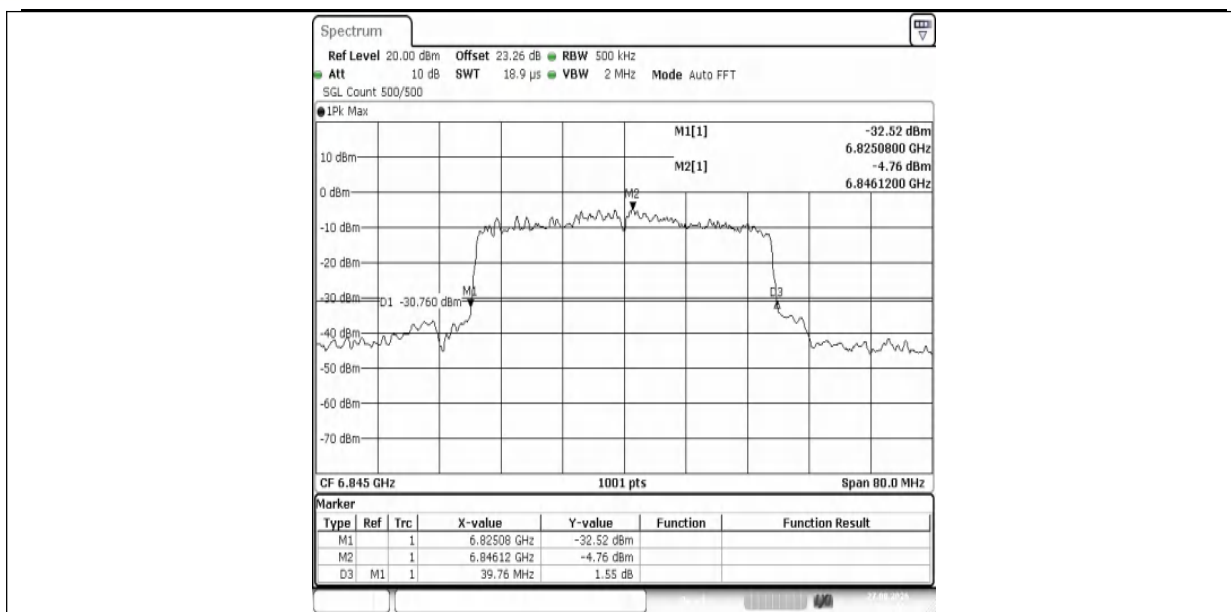

11AX40MIMO-Ant1-6845

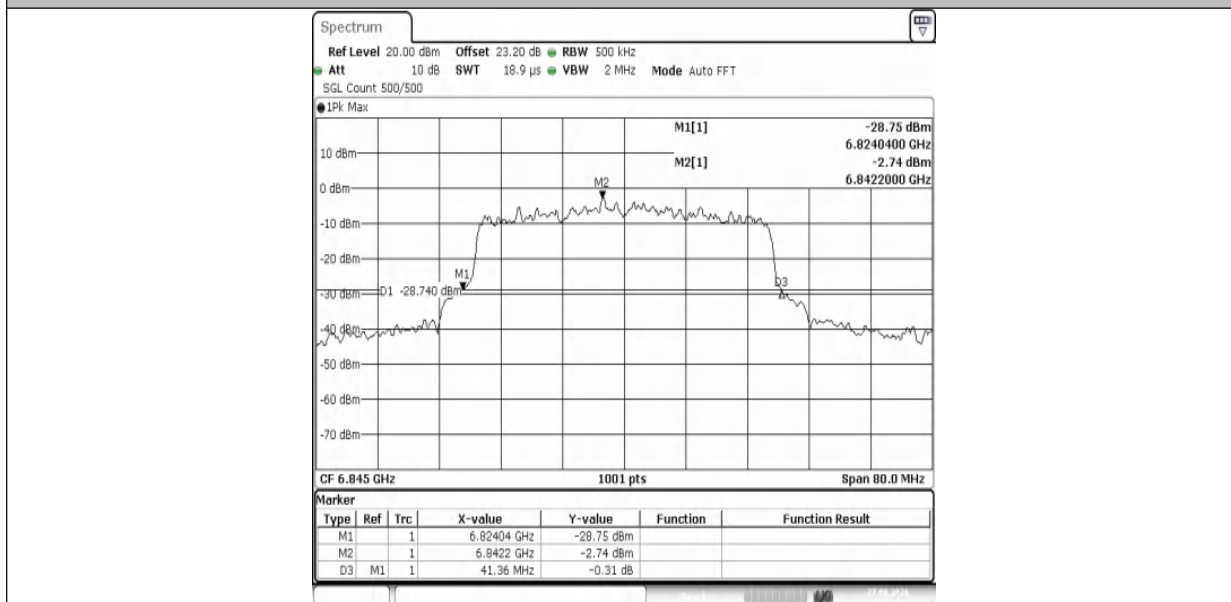


11AX40MIMO-Ant2-6845


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

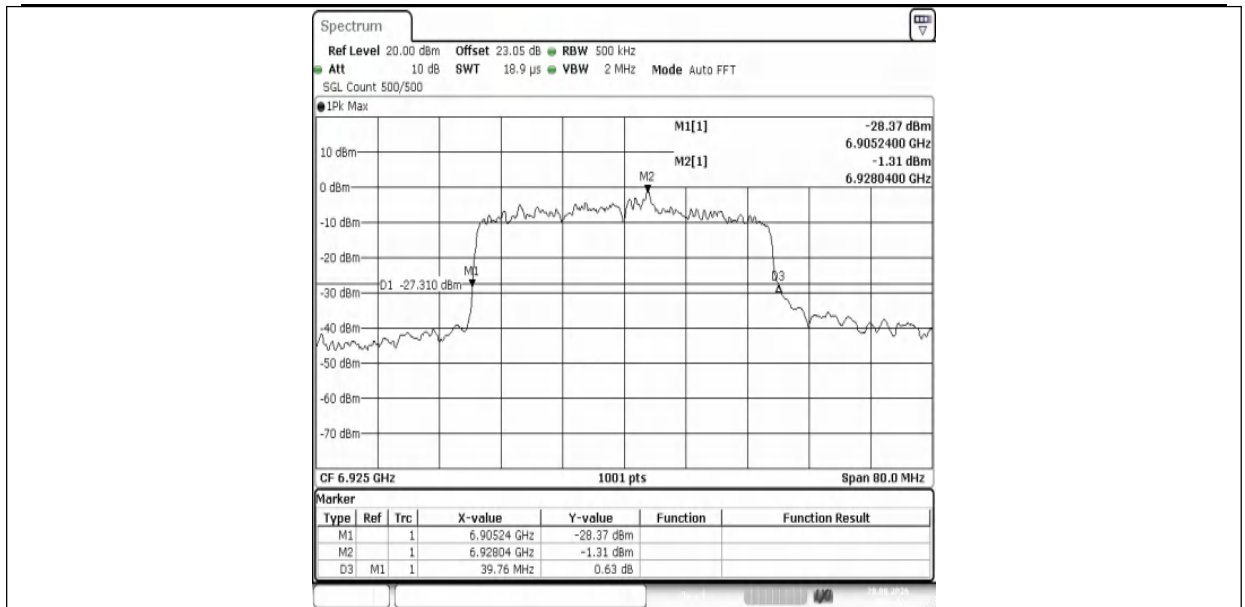


11AX40MIMO-Ant1-6925

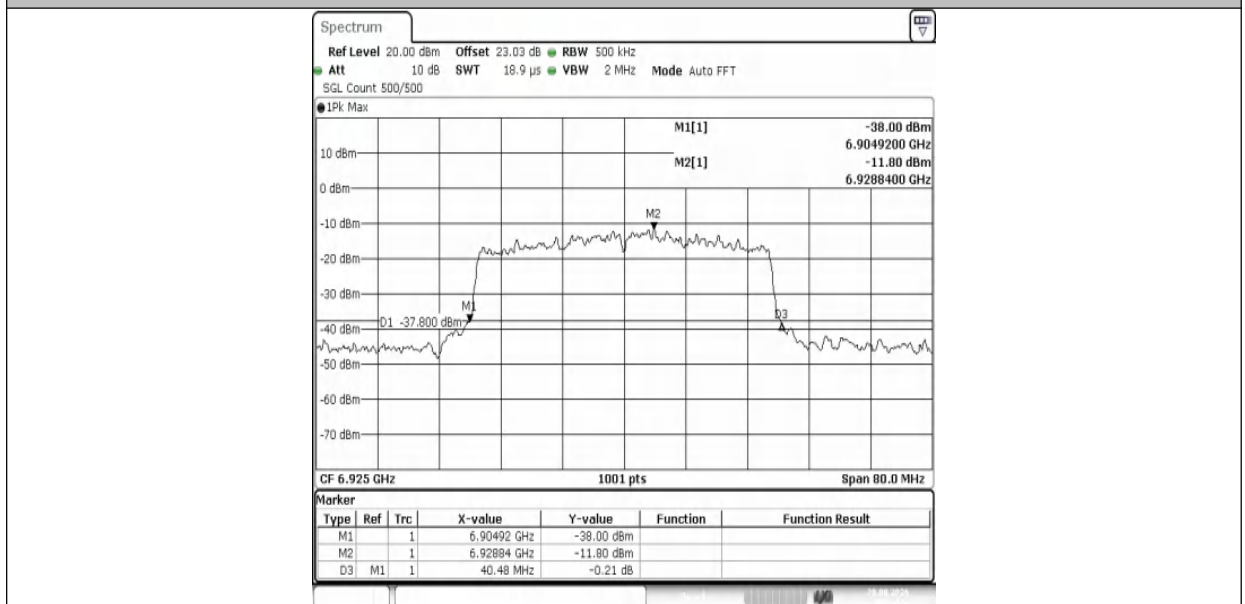

11AX40MIMO-Ant2-6925

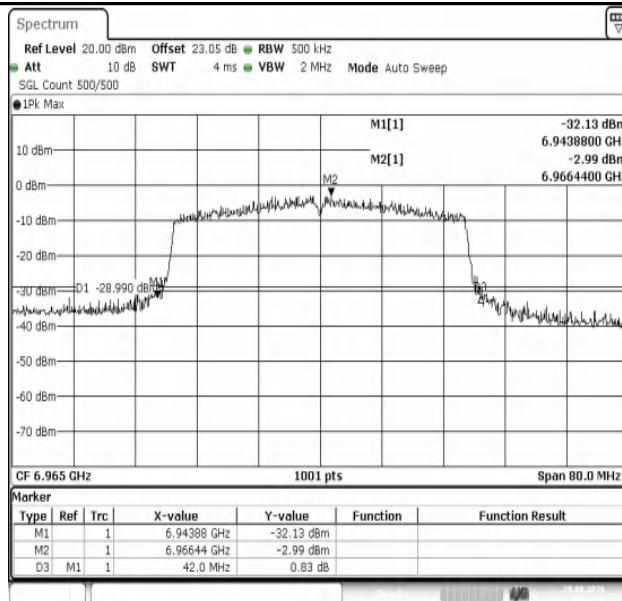

11AX40MIMO-Ant1-6965

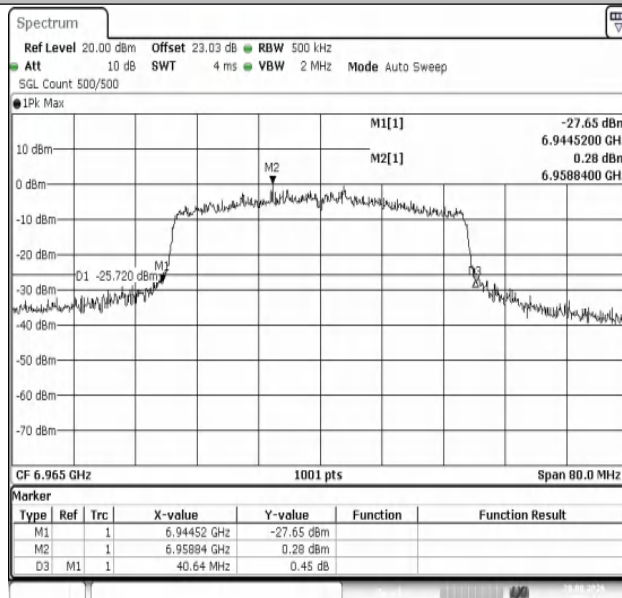


11AX40MIMO-Ant2-6965


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

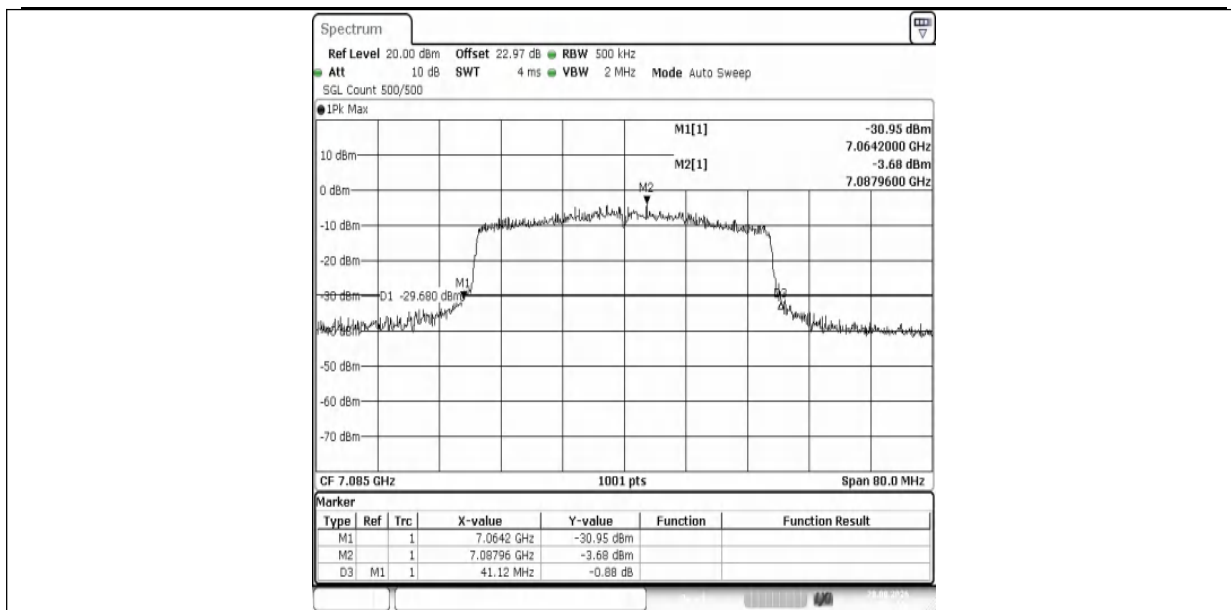


11AX40MIMO-Ant1-7085

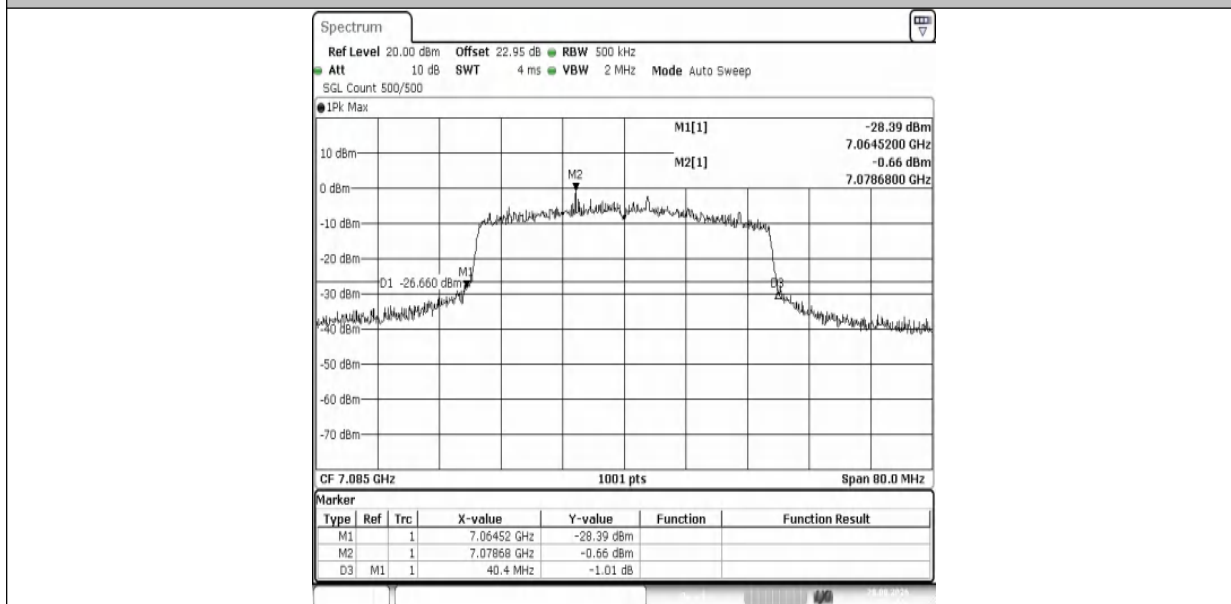

11AX40MIMO-Ant2-7085

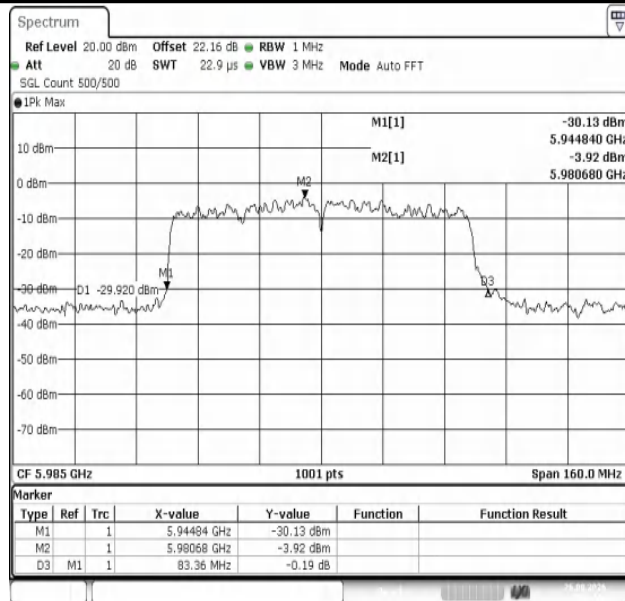

11AX80MIMO-Ant1-5985

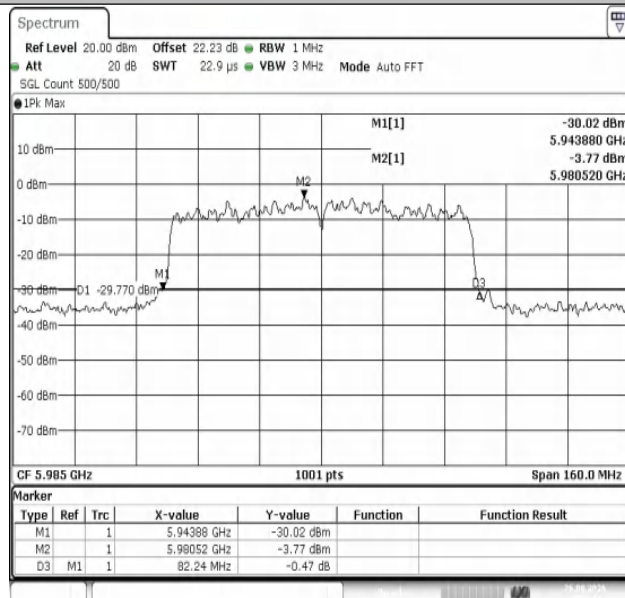


11AX80MIMO-Ant2-5985


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

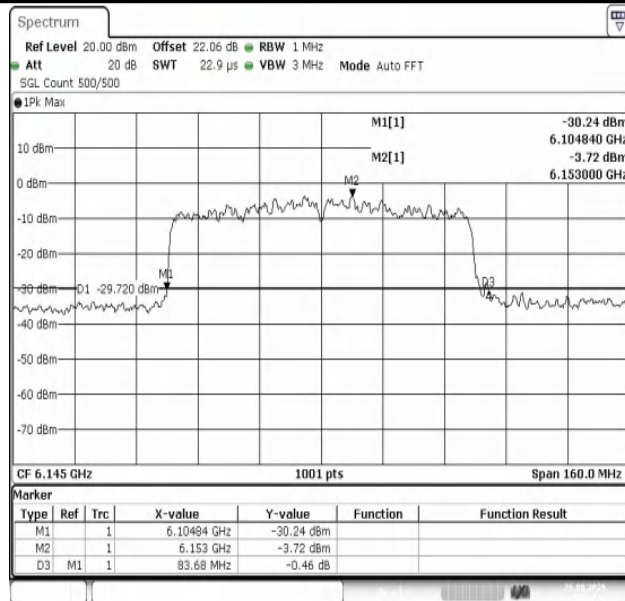

11AX80MIMO-Ant1-6145

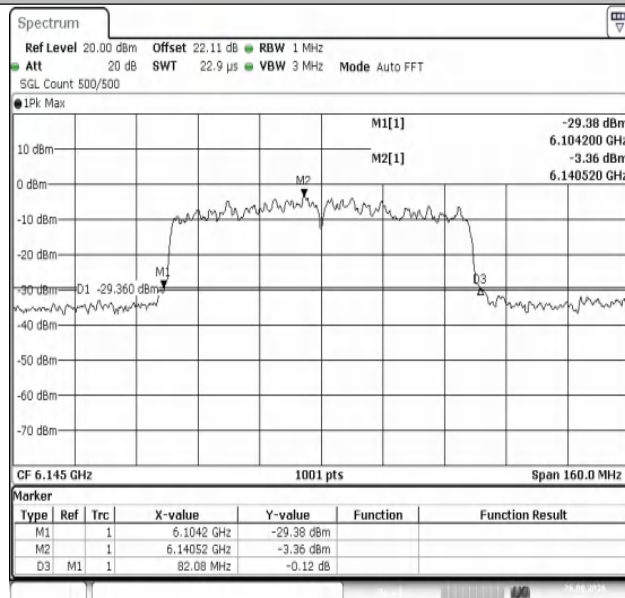



11AX80MIMO-Ant2-6145

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

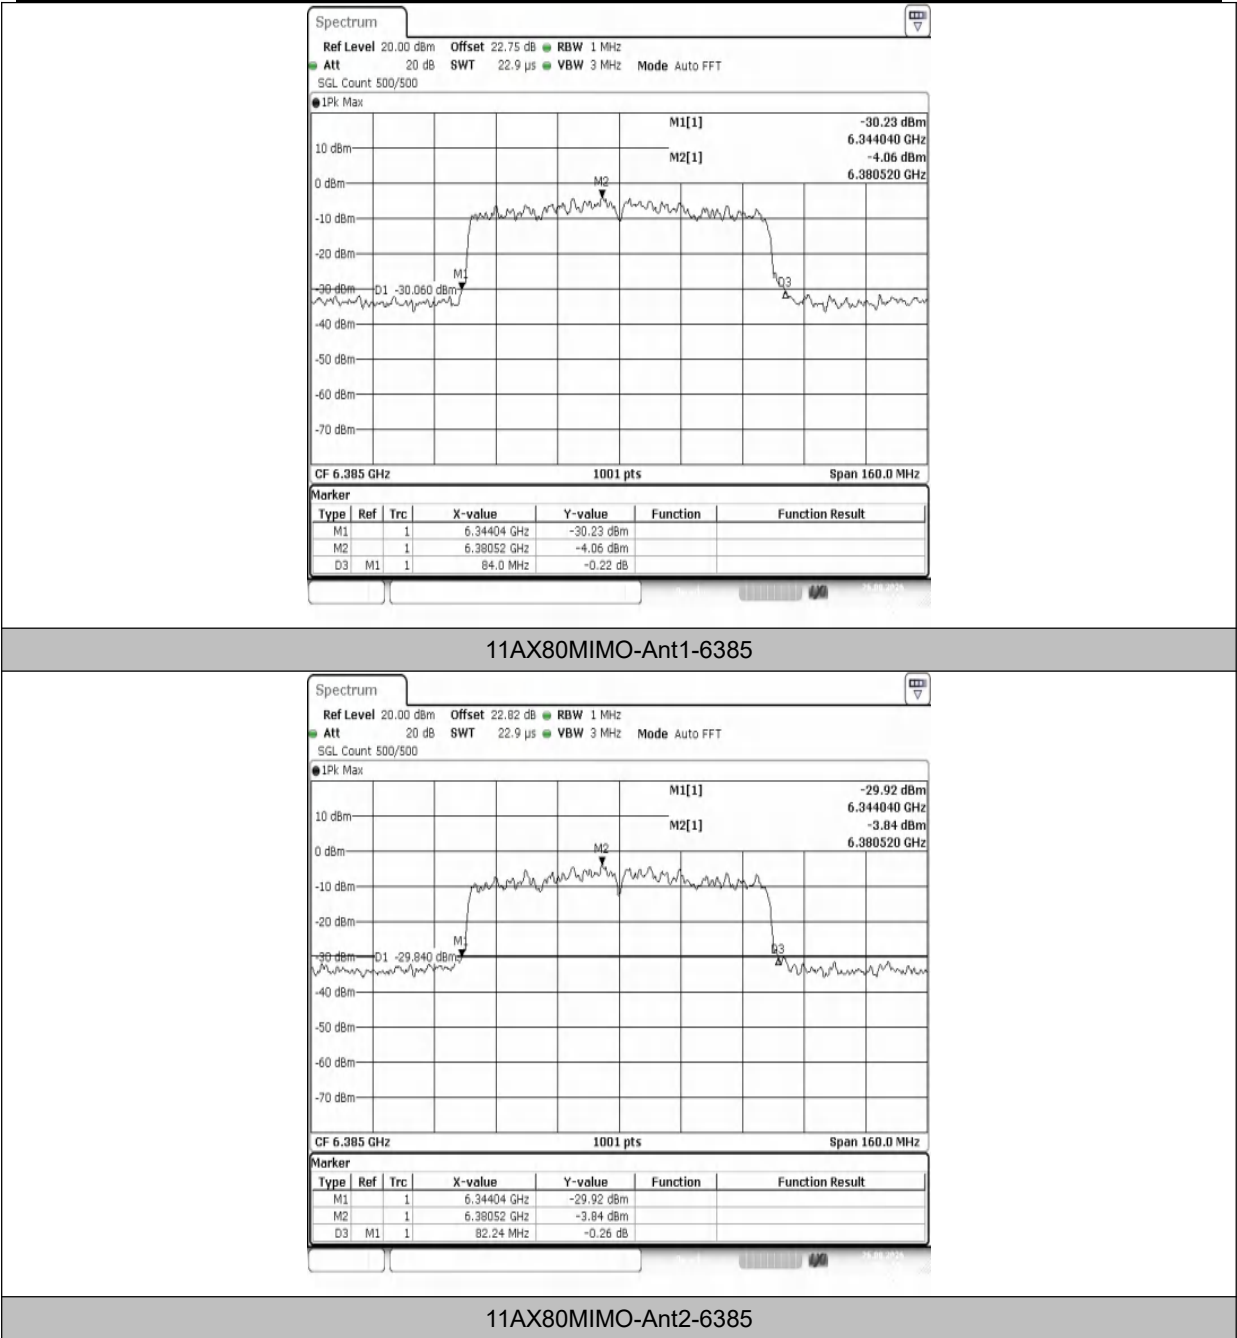


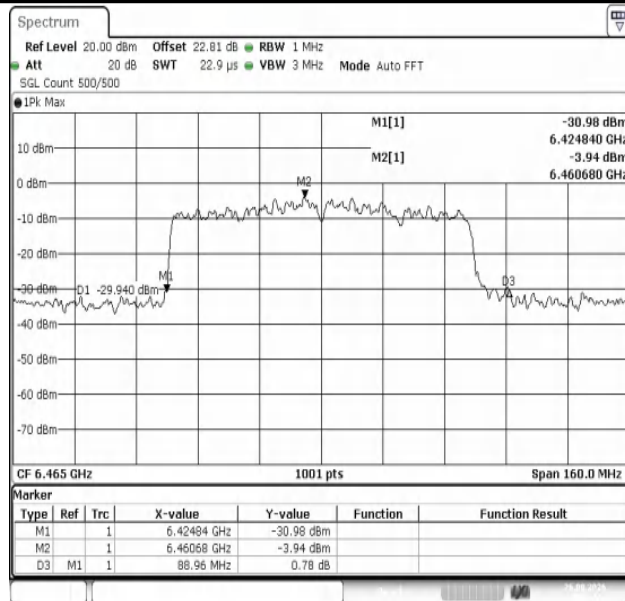


11AX80MIMO-Ant1-6465

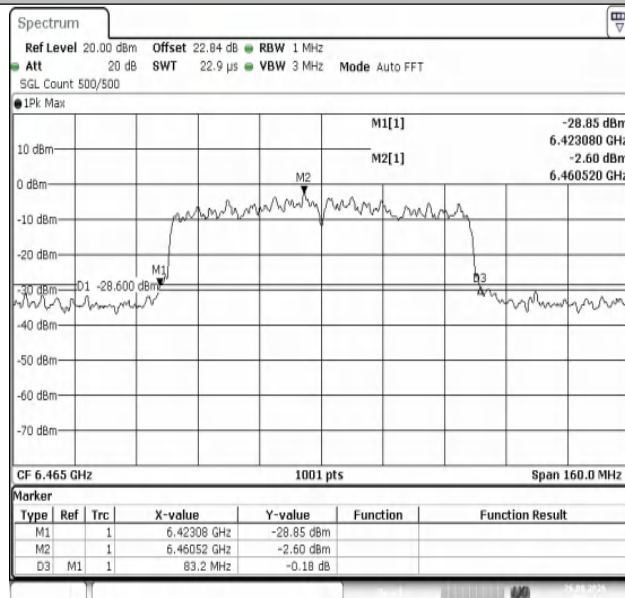


11AX80MIMO-Ant2-6465

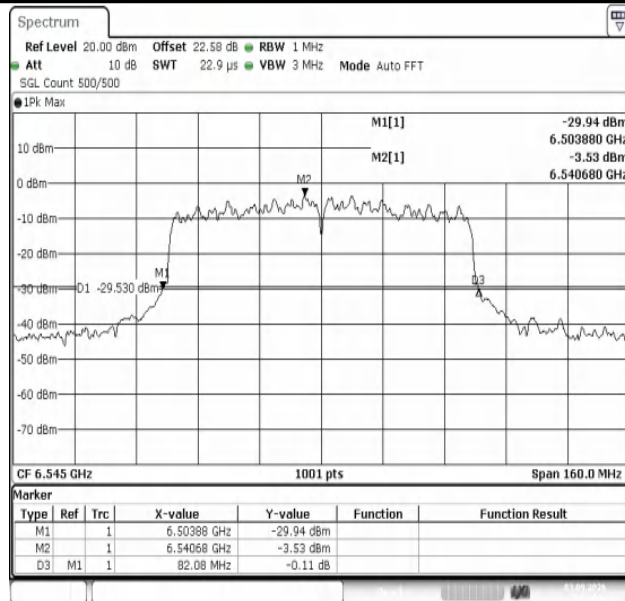


11AX80MIMO-Ant1-6545

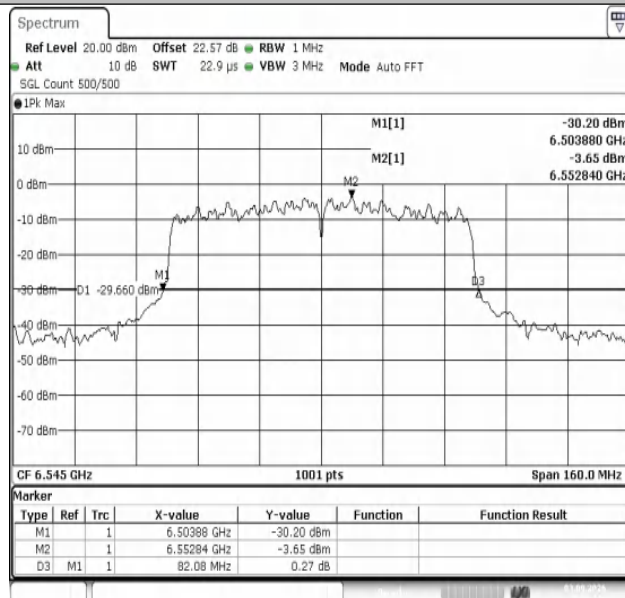


11AX80MIMO-Ant2-6545

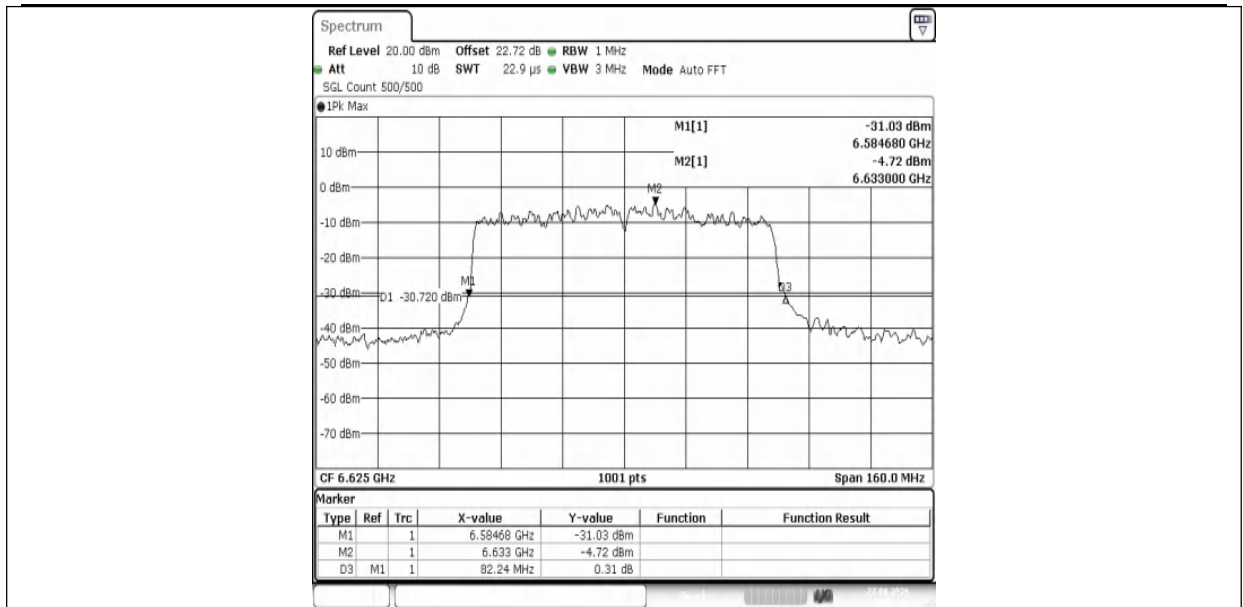


11AX80MIMO-Ant1-6625

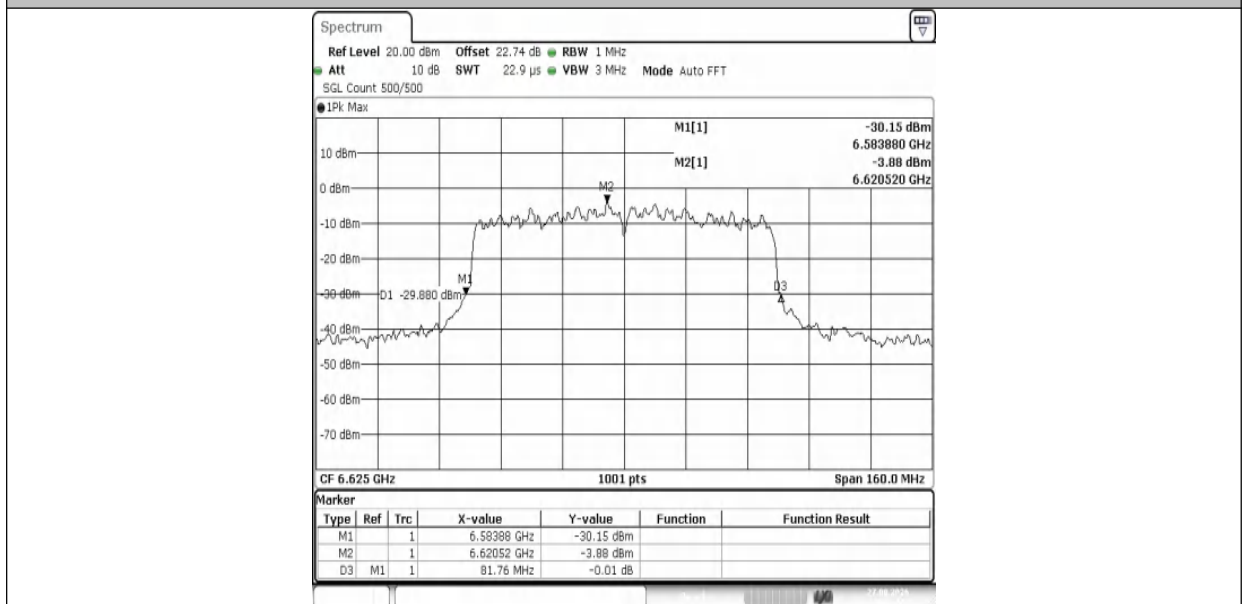


11AX80MIMO-Ant2-6625

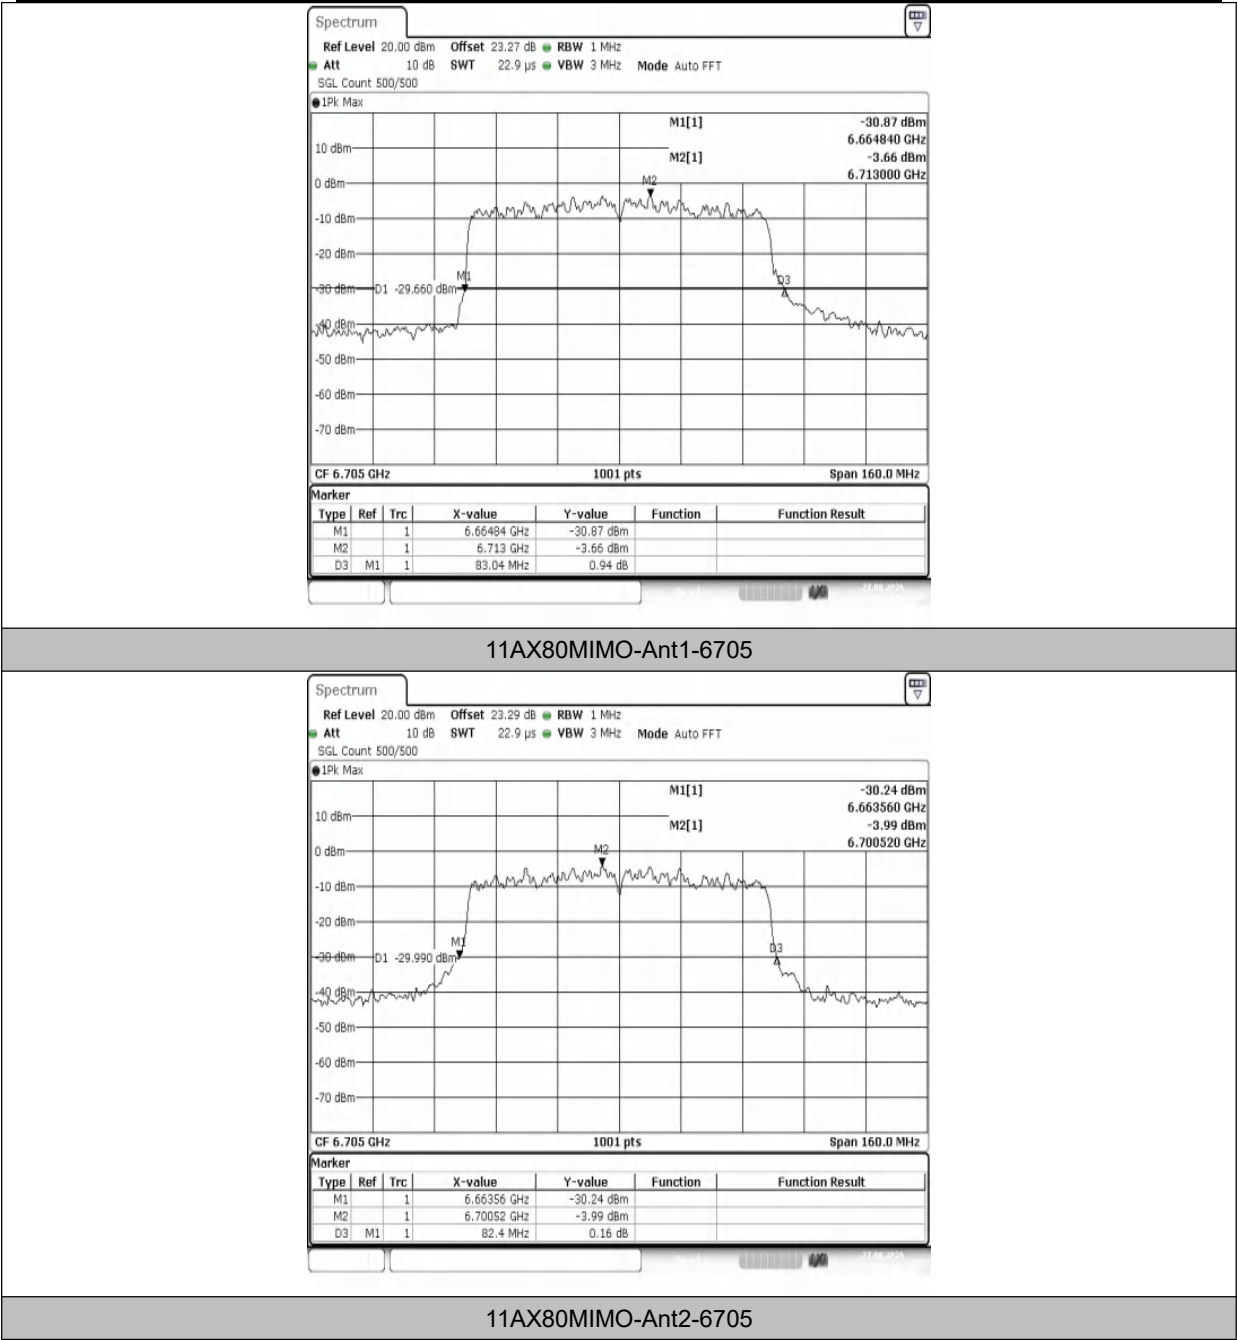


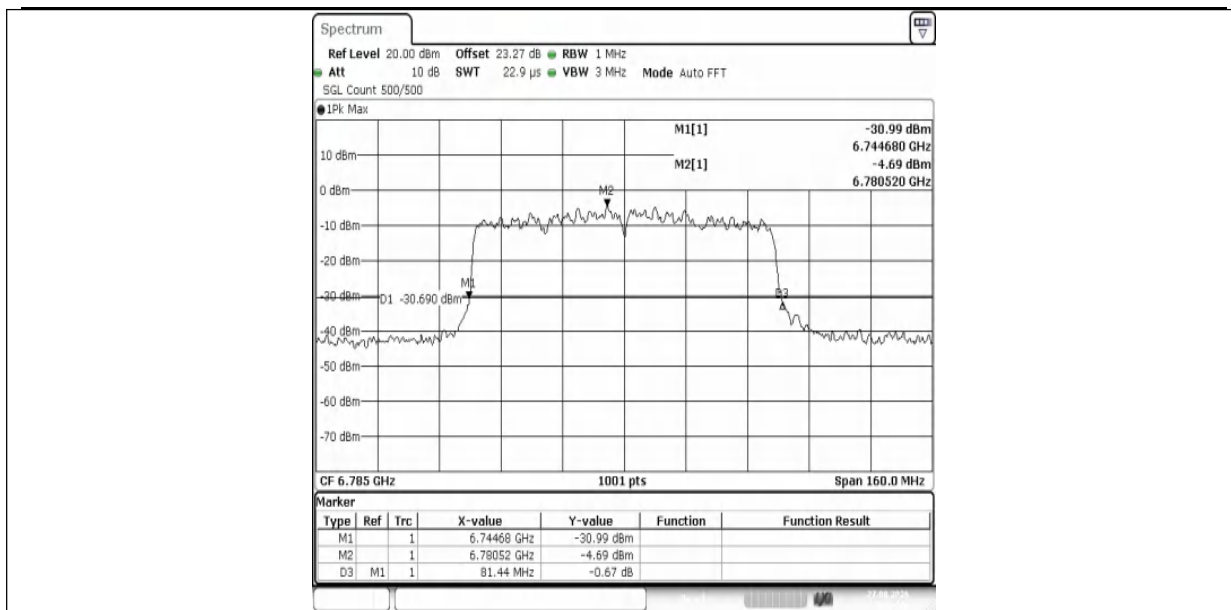


11AX80MIMO-Ant1-6785

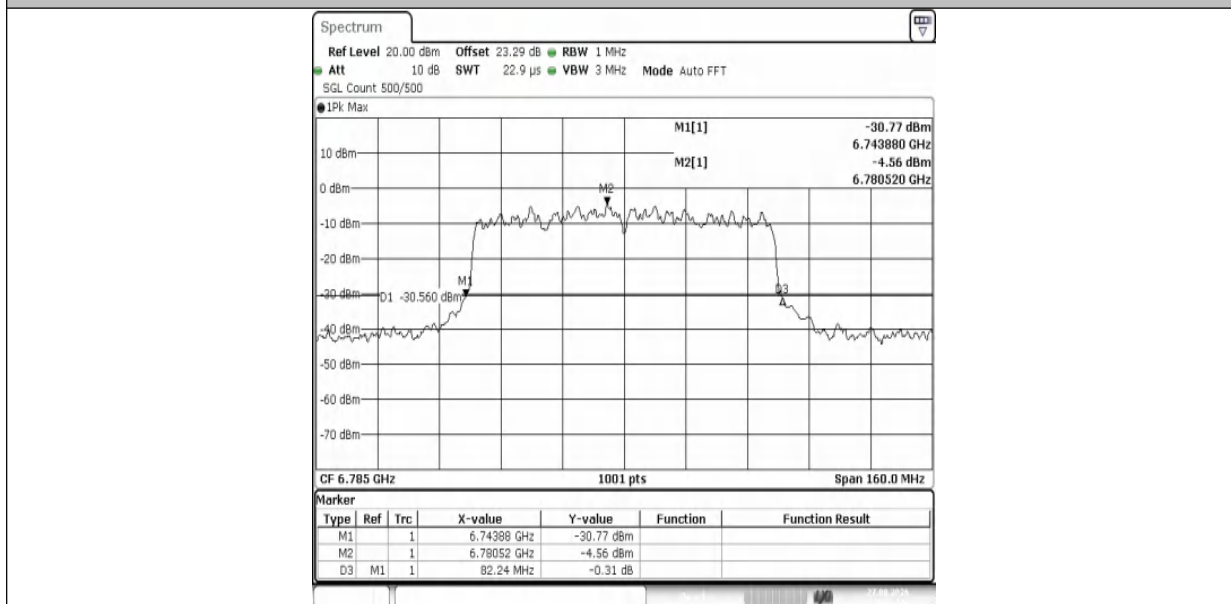


11AX80MIMO-Ant2-6785

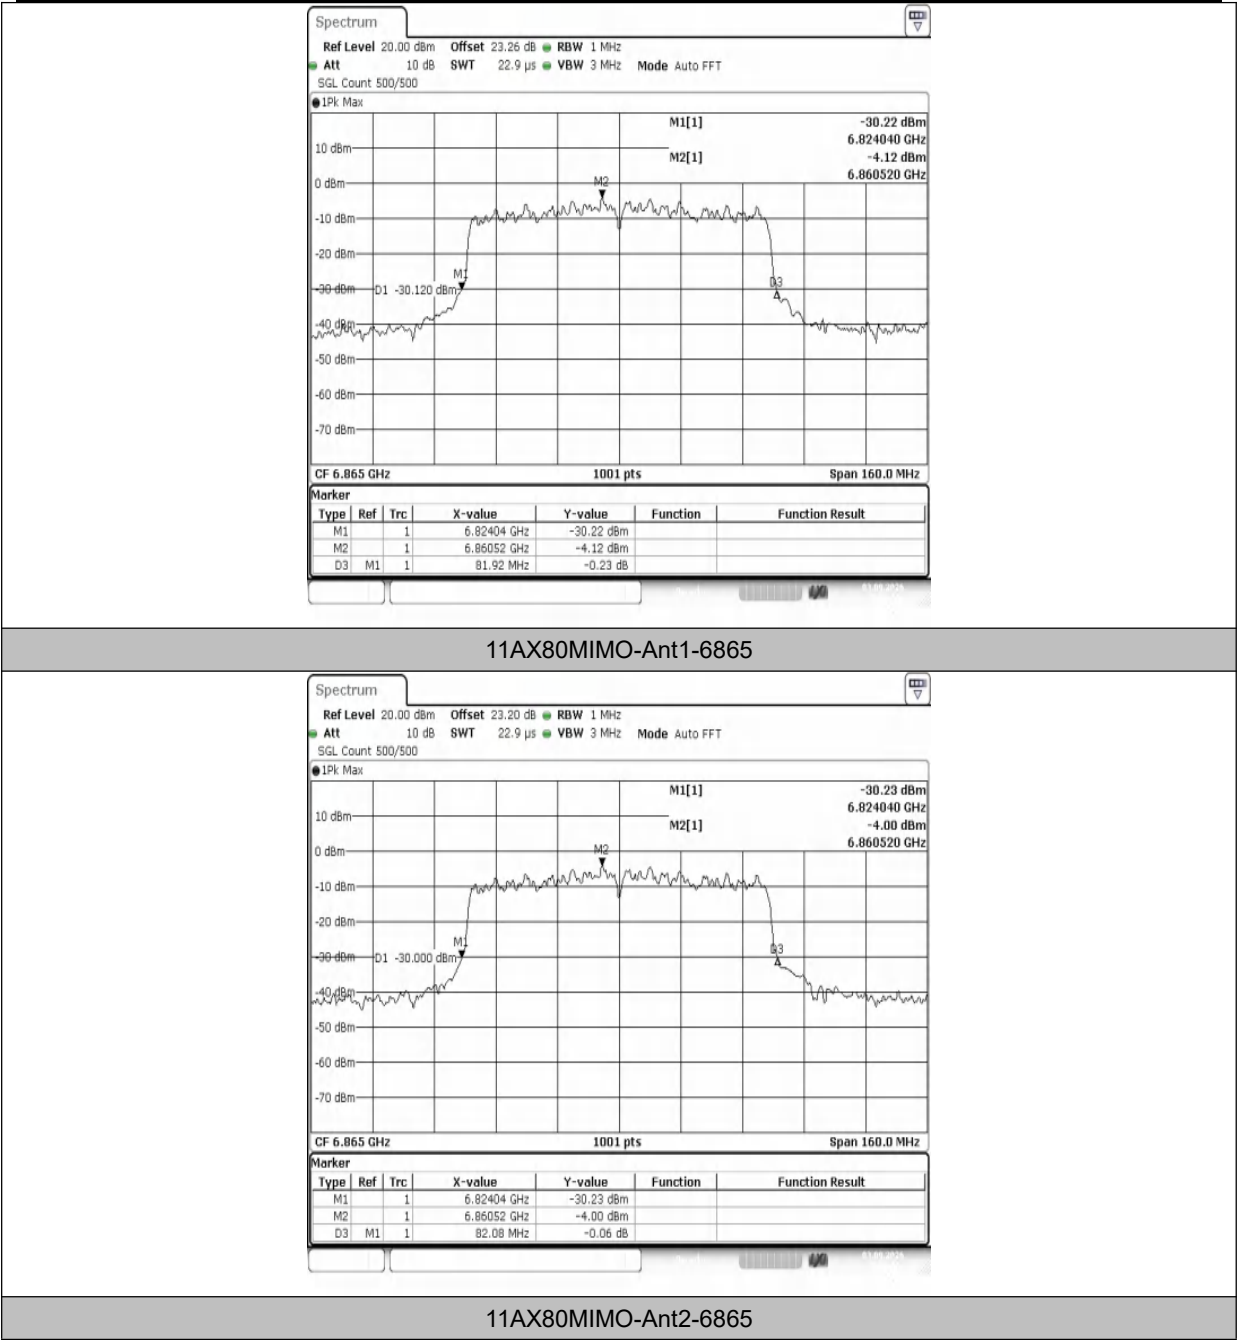

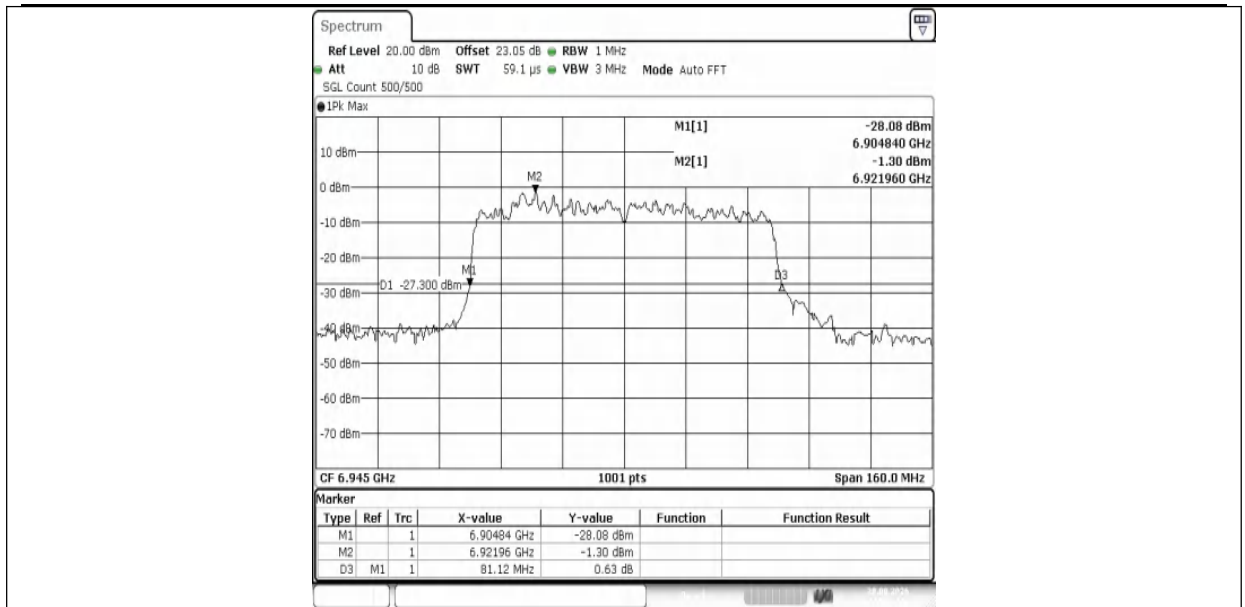

11AX80MIMO-Ant1-6945

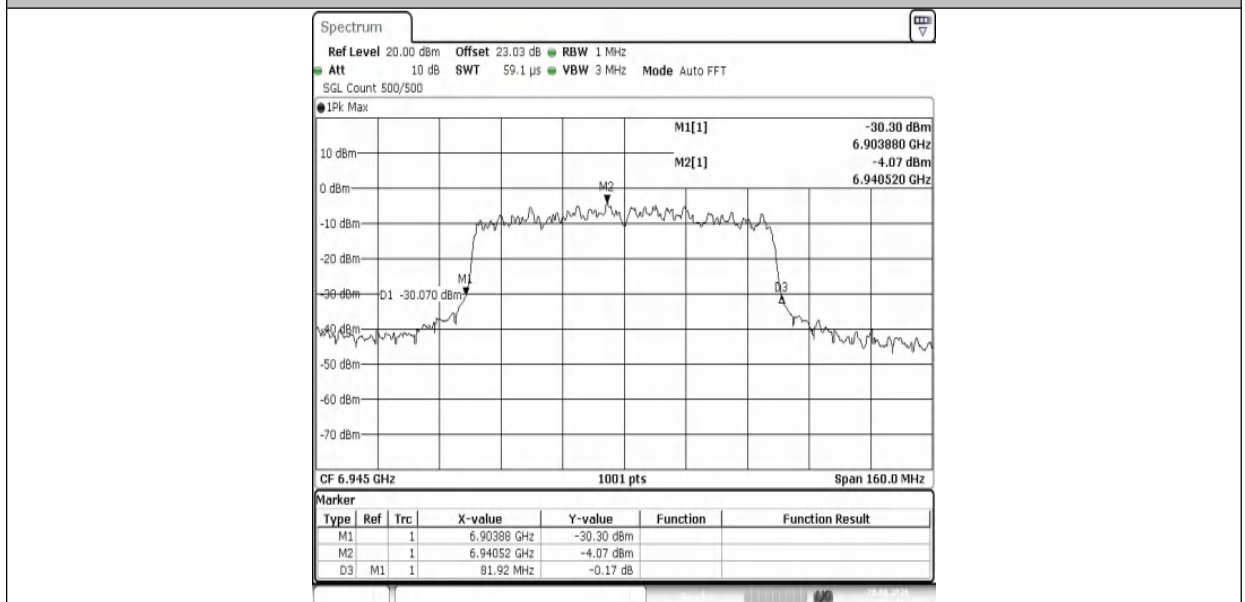


11AX80MIMO-Ant2-6945


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

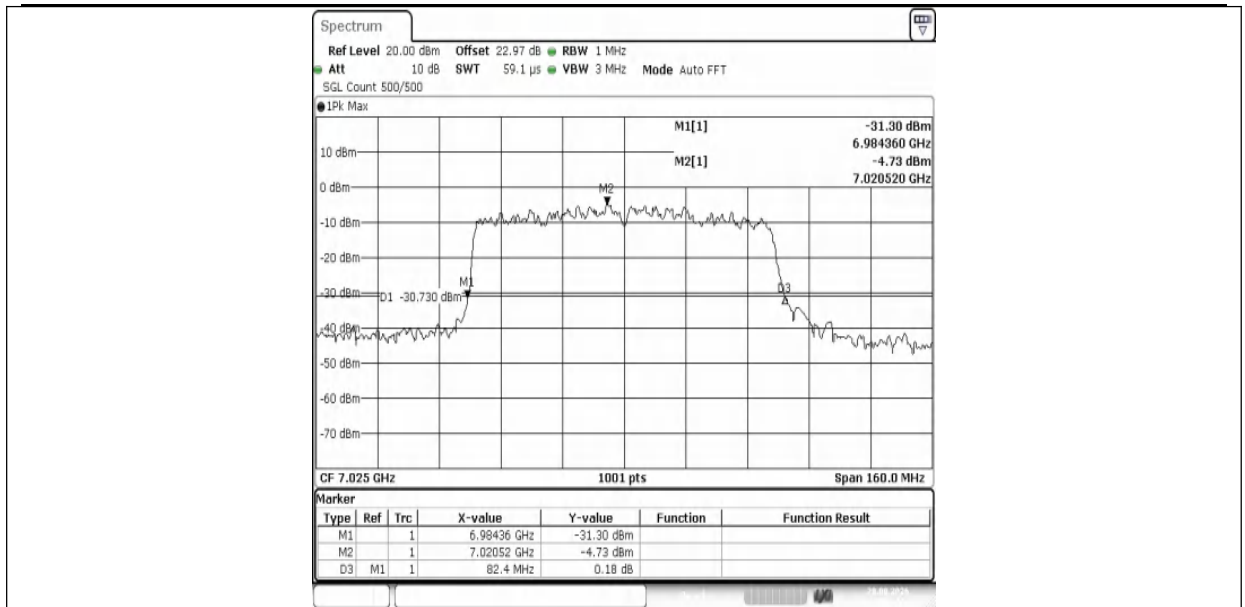

11AX80MIMO-Ant1-7025

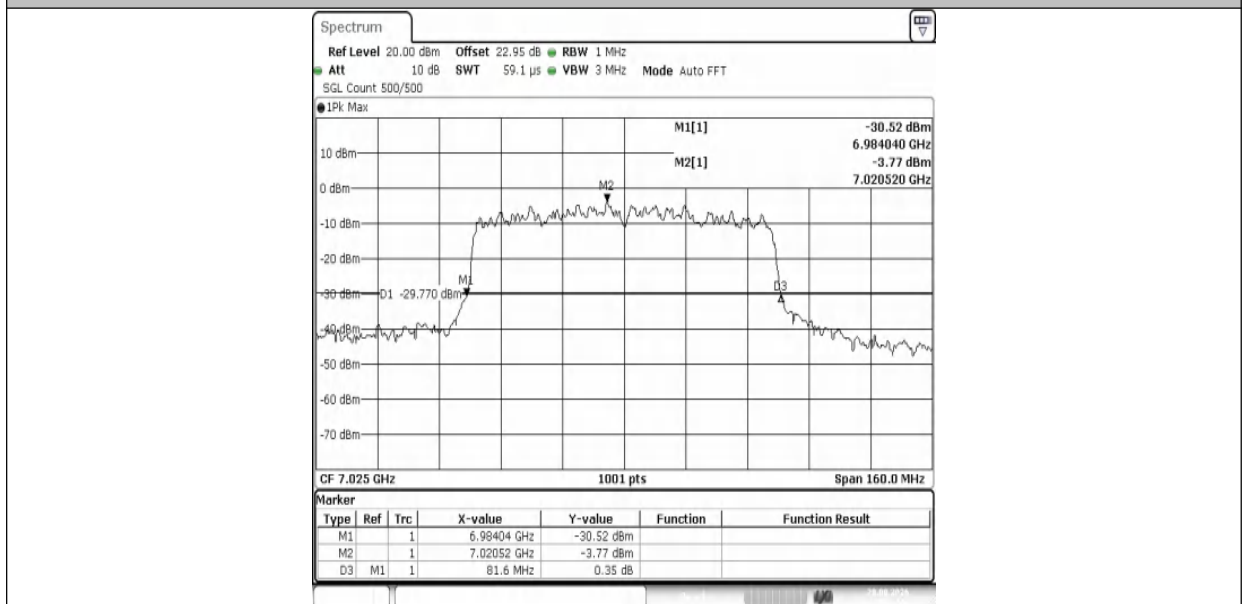

11AX80MIMO-Ant2-7025


Appendix A2: Occupied channel bandwidth

Test Result

TestMode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11AX20MIMO	Ant1	5955	19.261	5945.3696	5964.6304	≤320	PASS
11AX20MIMO	Ant2	5955	19.101	5945.4096	5964.5105	≤320	PASS
11AX20MIMO	Ant1	6175	19.221	6165.3696	6184.5904	≤320	PASS
11AX20MIMO	Ant2	6175	19.181	6165.4496	6184.6304	≤320	PASS
11AX20MIMO	Ant1	6415	19.061	6405.4096	6424.4705	≤320	PASS
11AX20MIMO	Ant2	6415	19.141	6405.3696	6424.5105	≤320	PASS
11AX20MIMO	Ant1	6435	19.500	6425.0899	6444.5904	≤320	PASS
11AX20MIMO	Ant2	6435	19.141	6425.3696	6444.5105	≤320	PASS
11AX20MIMO	Ant1	6475	19.181	6465.3696	6484.5504	≤320	PASS
11AX20MIMO	Ant2	6475	19.301	6465.4096	6484.7103	≤320	PASS
11AX20MIMO	Ant1	6515	19.141	6505.3297	6524.4705	≤320	PASS
11AX20MIMO	Ant2	6515	19.301	6505.4496	6524.7502	≤320	PASS
11AX20MIMO	Ant1	6535	19.181	6525.3696	6544.5504	≤320	PASS
11AX20MIMO	Ant2	6535	19.181	6525.3696	6544.5504	≤320	PASS
11AX20MIMO	Ant1	6695	19.181	6685.3297	6704.5105	≤320	PASS
11AX20MIMO	Ant2	6695	19.421	6685.3297	6704.7502	≤320	PASS
11AX20MIMO	Ant1	6855	19.141	6845.3696	6864.5105	≤320	PASS
11AX20MIMO	Ant2	6855	19.261	6845.2498	6864.5105	≤320	PASS
11AX20MIMO	Ant1	6875	19.221	6865.4096	6884.6304	≤320	PASS
11AX20MIMO	Ant2	6875	19.181	6865.4496	6884.6304	≤320	PASS
11AX20MIMO	Ant1	6895	19.141	6885.4096	6904.5504	≤320	PASS
11AX20MIMO	Ant2	6895	19.181	6885.3696	6904.5504	≤320	PASS
11AX20MIMO	Ant1	6995	19.660	6985.0100	7004.6703	≤320	PASS
11AX20MIMO	Ant2	6995	19.620	6985.0500	7004.6703	≤320	PASS
11AX20MIMO	Ant1	7115	19.500	7105.2498	7124.7502	≤320	PASS
11AX20MIMO	Ant2	7115	19.500	7105.2498	7124.7502	≤320	PASS
11AX40MIMO	Ant1	5965	37.802	5945.9790	5983.7812	≤320	PASS
11AX40MIMO	Ant2	5965	37.802	5946.0589	5983.8611	≤320	PASS
11AX40MIMO	Ant1	6165	37.642	6146.1389	6183.7812	≤320	PASS
11AX40MIMO	Ant2	6165	37.882	6145.9790	6183.8611	≤320	PASS
11AX40MIMO	Ant1	6405	37.722	6386.0589	6423.7812	≤320	PASS
11AX40MIMO	Ant2	6405	37.962	6385.9790	6423.9411	≤320	PASS
11AX40MIMO	Ant1	6445	37.802	6426.0589	6463.8611	≤320	PASS
11AX40MIMO	Ant2	6445	37.882	6426.0589	6463.9411	≤320	PASS
11AX40MIMO	Ant1	6485	37.802	6466.0589	6503.8611	≤320	PASS
11AX40MIMO	Ant2	6485	37.802	6466.0589	6503.8611	≤320	PASS
11AX40MIMO	Ant1	6565	37.483	6546.2188	6583.7013	≤320	PASS
11AX40MIMO	Ant2	6565	37.722	6546.0589	6583.7812	≤320	PASS

11AX40MIMO	Ant1	6685	37.722	6666.1389	6703.8611	≤320	PASS
11AX40MIMO	Ant2	6685	37.642	6666.1389	6703.7812	≤320	PASS
11AX40MIMO	Ant1	6845	37.722	6826.0589	6863.7812	≤320	PASS
11AX40MIMO	Ant2	6845	37.962	6826.0589	6864.0210	≤320	PASS
11AX40MIMO	Ant1	6925	37.722	6905.9790	6943.7013	≤320	PASS
11AX40MIMO	Ant2	6925	39.081	6905.4196	6944.5005	≤320	PASS
11AX40MIMO	Ant1	6965	37.722	6946.0589	6983.7812	≤320	PASS
11AX40MIMO	Ant2	6965	37.722	6946.0589	6983.7812	≤320	PASS
11AX40MIMO	Ant1	7085	37.722	7066.0589	7103.7812	≤320	PASS
11AX40MIMO	Ant2	7085	37.642	7066.0589	7103.7013	≤320	PASS
11AX80MIMO	Ant1	5985	77.363	5946.3187	6023.6813	≤320	PASS
11AX80MIMO	Ant2	5985	77.363	5946.1588	6023.5215	≤320	PASS
11AX80MIMO	Ant1	6145	77.203	6106.4785	6183.6813	≤320	PASS
11AX80MIMO	Ant2	6145	77.203	6106.3187	6183.5215	≤320	PASS
11AX80MIMO	Ant1	6385	77.203	6346.3187	6423.5215	≤320	PASS
11AX80MIMO	Ant2	6385	77.363	6346.1588	6423.5215	≤320	PASS
11AX80MIMO	Ant1	6465	77.363	6426.3187	6503.6813	≤320	PASS
11AX80MIMO	Ant2	6465	77.203	6426.3187	6503.5215	≤320	PASS
11AX80MIMO	Ant1	6545	76.723	6506.6384	6583.3616	≤320	PASS
11AX80MIMO	Ant2	6545	76.883	6506.4785	6583.3616	≤320	PASS
11AX80MIMO	Ant1	6625	76.883	6586.4785	6663.3616	≤320	PASS
11AX80MIMO	Ant2	6625	76.883	6586.3187	6663.2018	≤320	PASS
11AX80MIMO	Ant1	6705	76.883	6666.4785	6743.3616	≤320	PASS
11AX80MIMO	Ant2	6705	77.043	6666.3187	6743.3616	≤320	PASS
11AX80MIMO	Ant1	6785	77.043	6746.3187	6823.3616	≤320	PASS
11AX80MIMO	Ant2	6785	77.043	6746.3187	6823.3616	≤320	PASS
11AX80MIMO	Ant1	6865	77.203	6826.3187	6903.5215	≤320	PASS
11AX80MIMO	Ant2	6865	77.043	6826.4785	6903.5215	≤320	PASS
11AX80MIMO	Ant1	6945	76.883	6906.4785	6983.3616	≤320	PASS
11AX80MIMO	Ant2	6945	76.883	6906.3187	6983.2018	≤320	PASS
11AX80MIMO	Ant1	7025	76.883	6986.3187	7063.2018	≤320	PASS
11AX80MIMO	Ant2	7025	76.883	6986.3187	7063.2018	≤320	PASS


Test Graphs

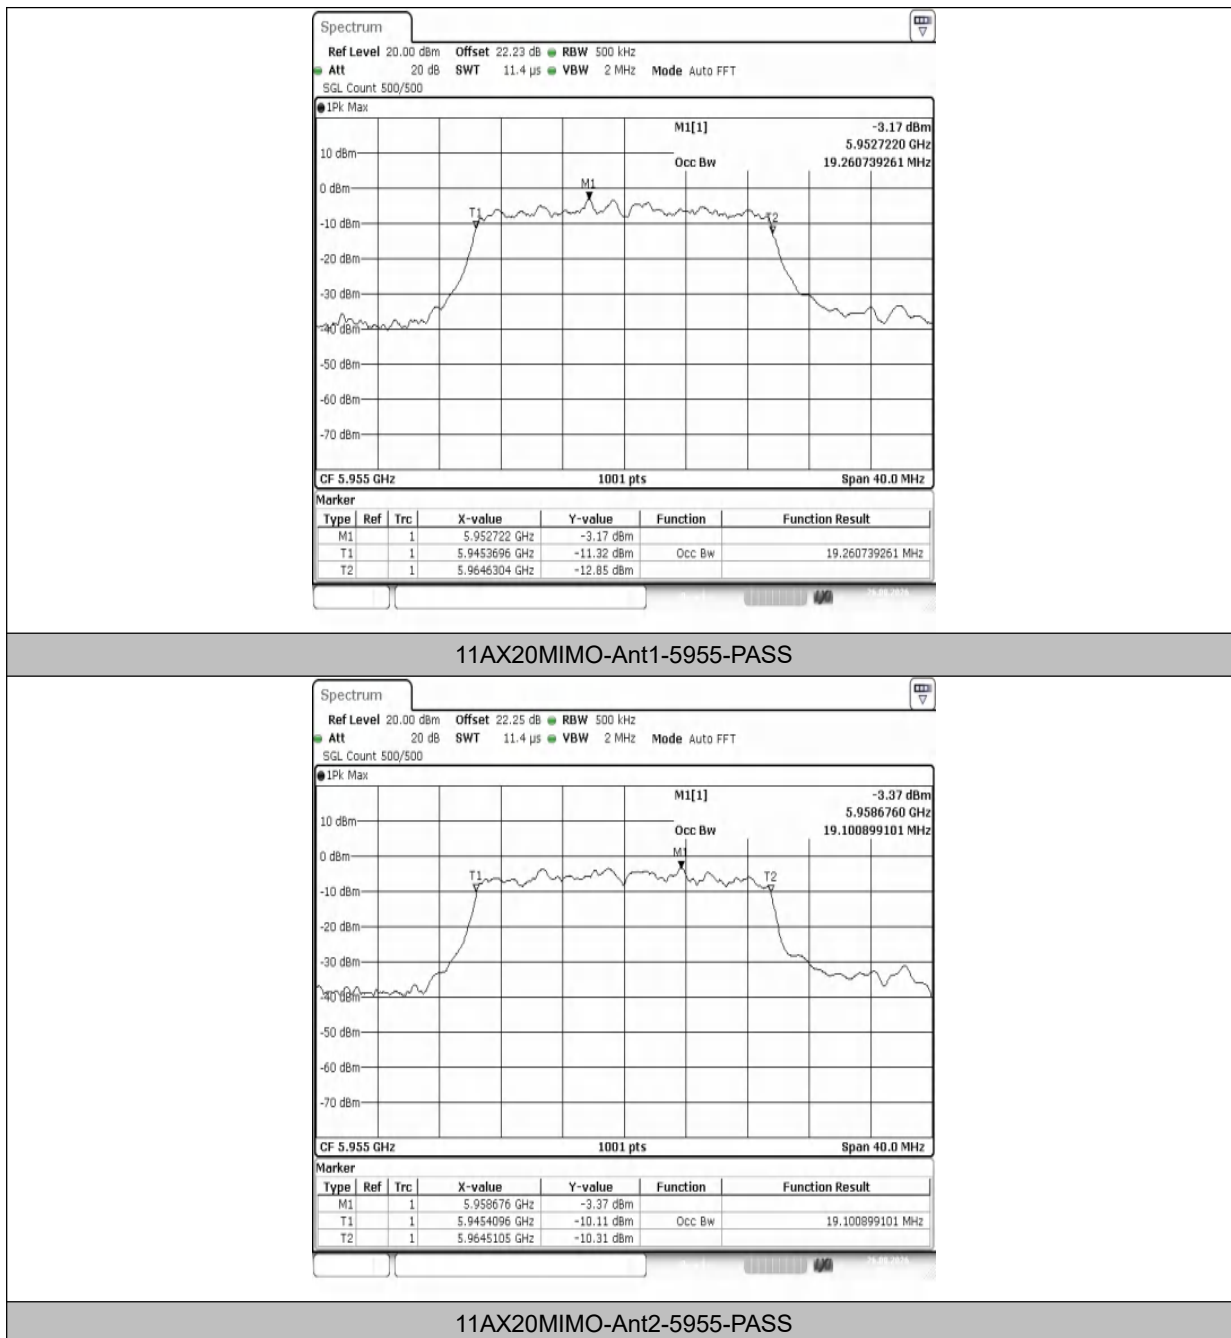



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

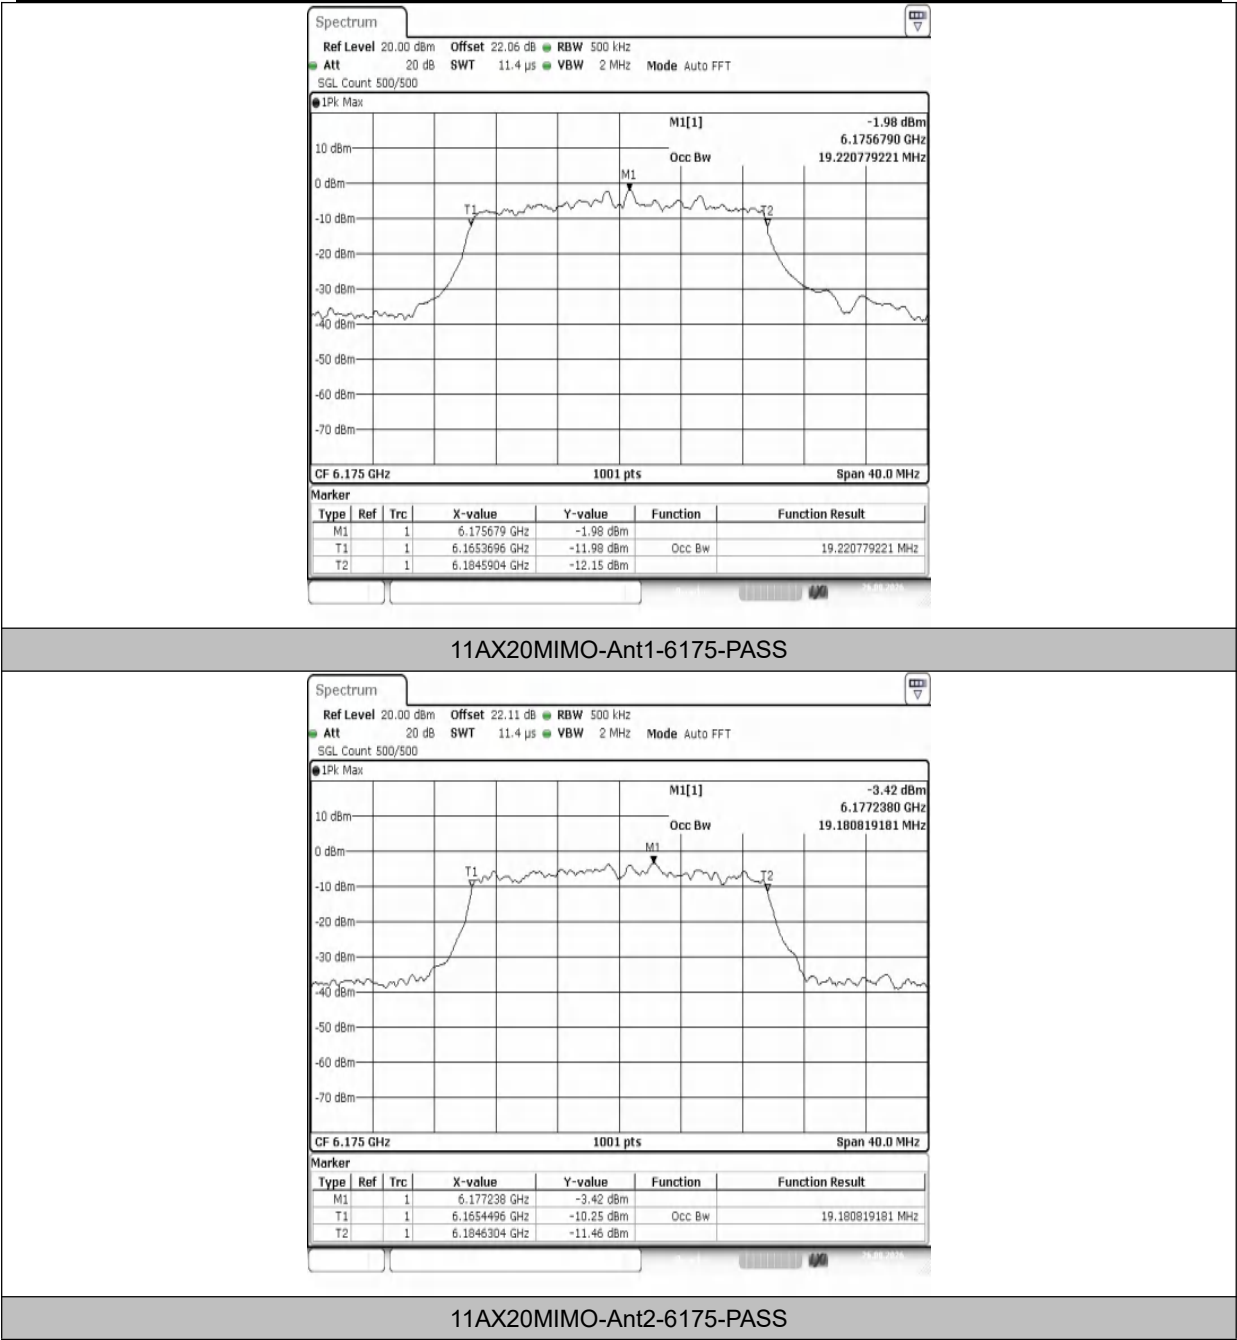


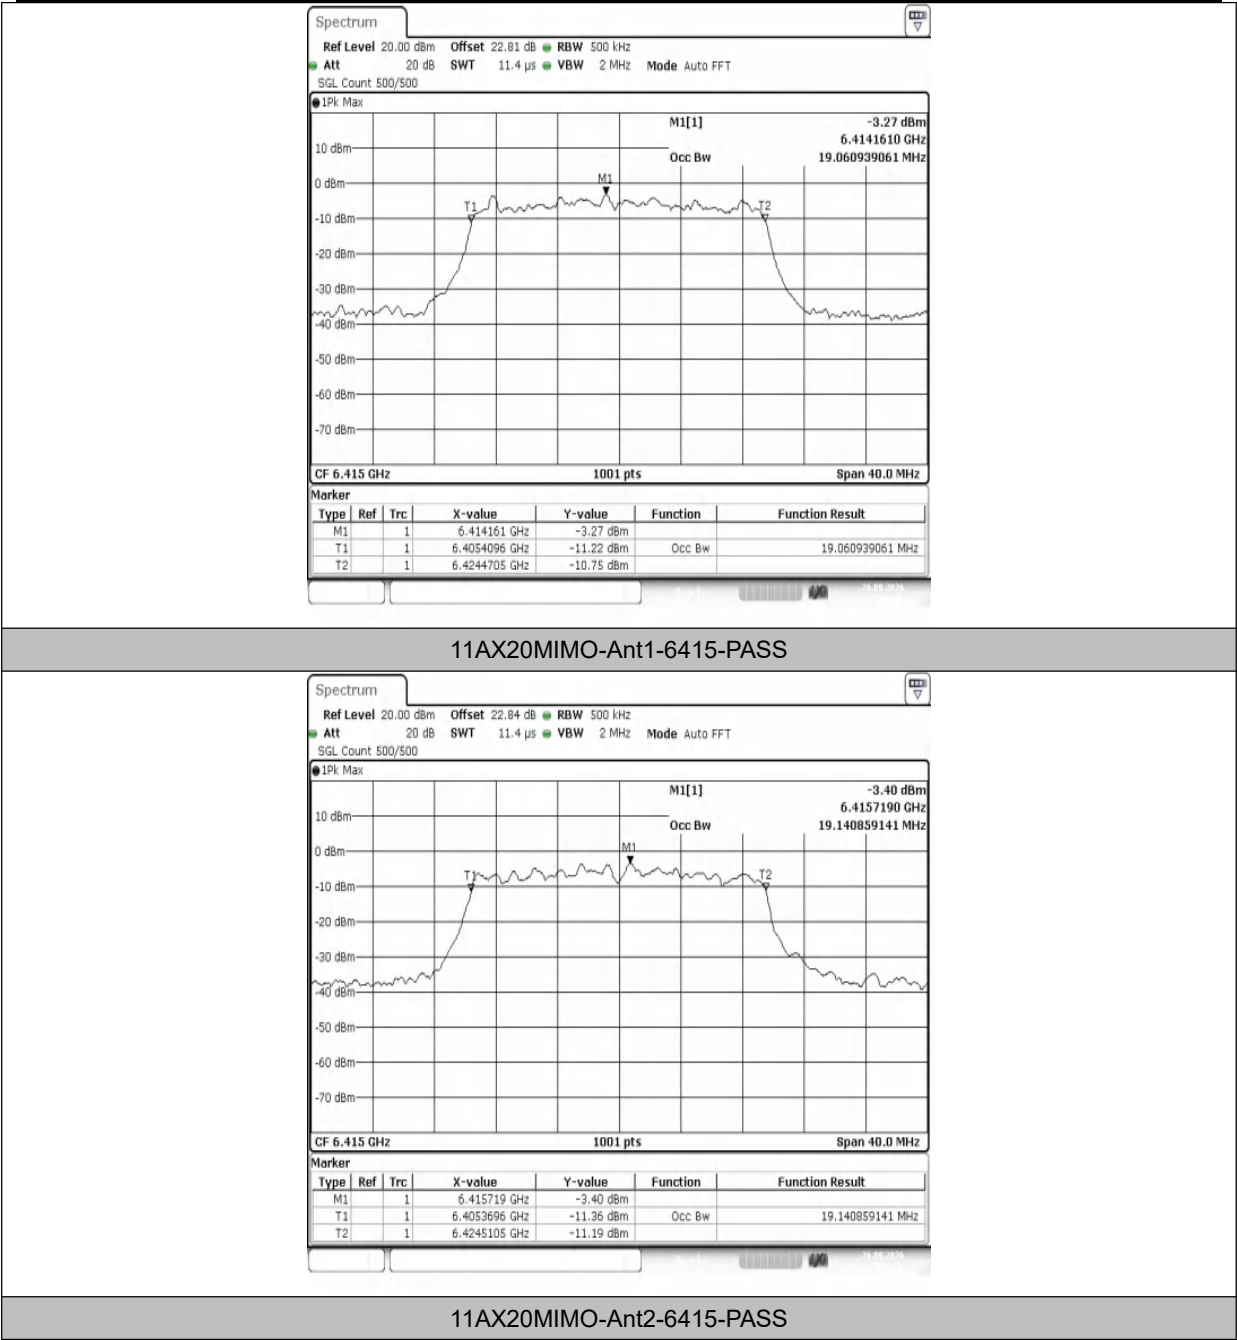

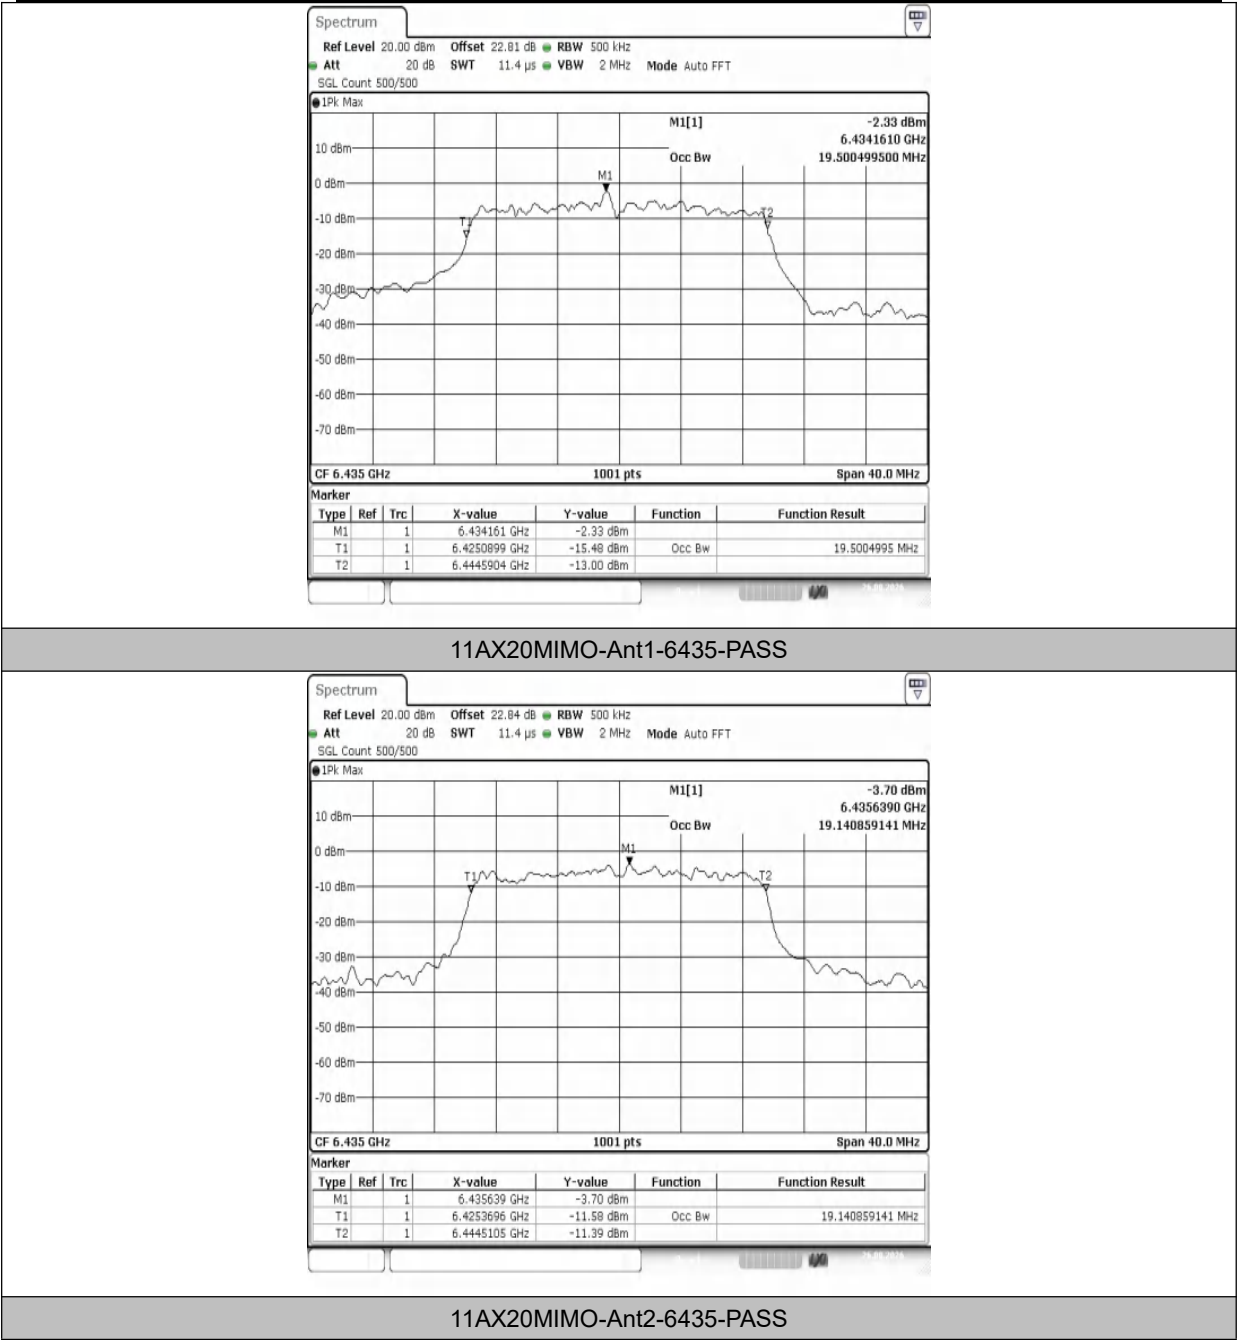


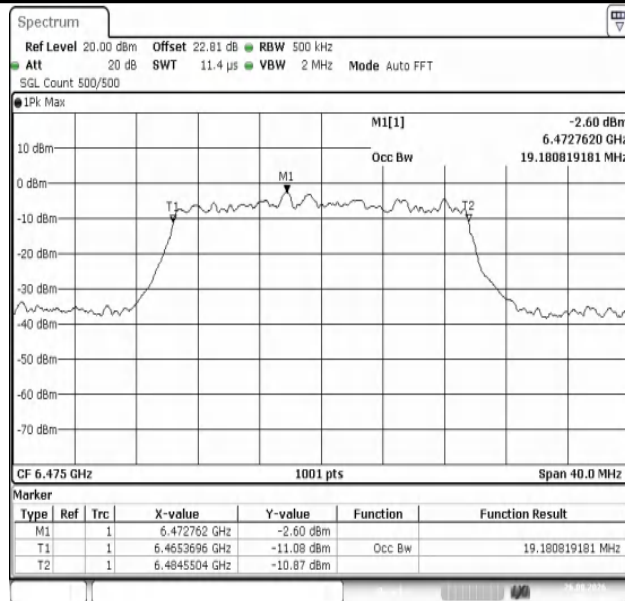


11AX20MIMO-Ant1-6475-PASS

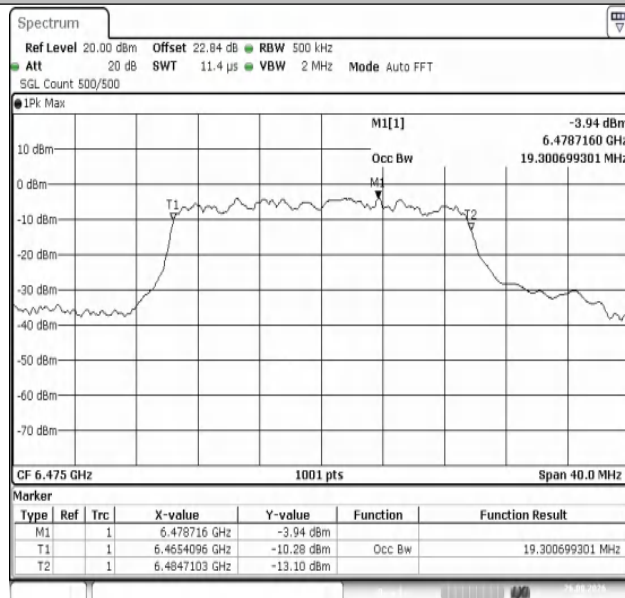

11AX20MIMO-Ant2-6475-PASS

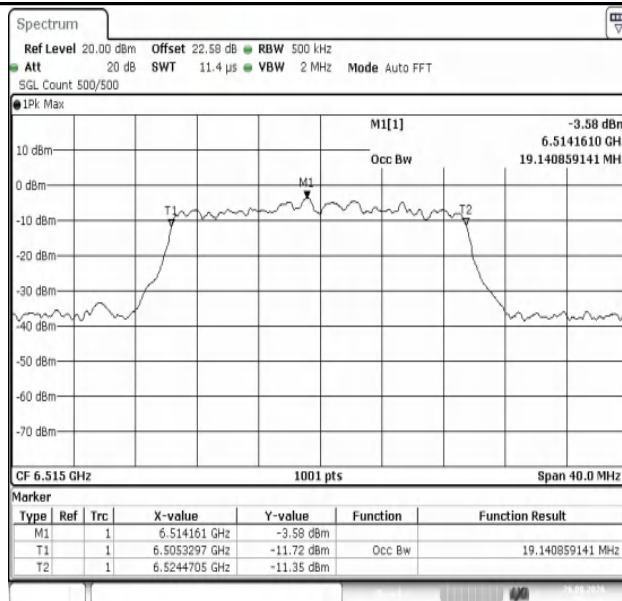

11AX20MIMO-Ant1-6515-PASS

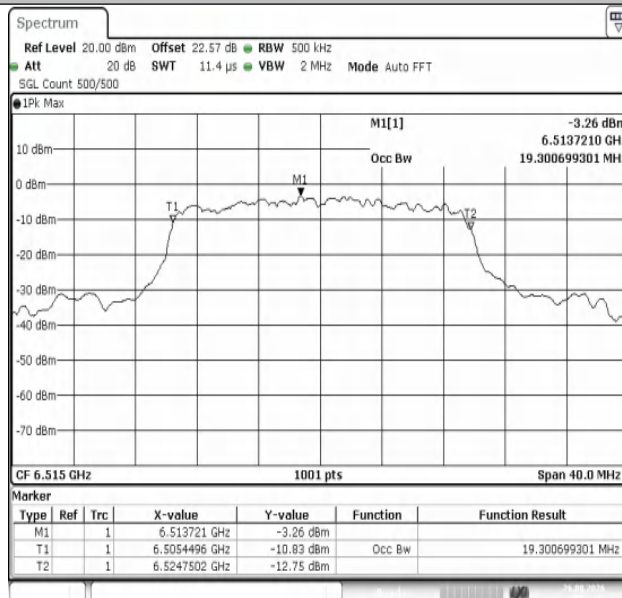


11AX20MIMO-Ant2-6515-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

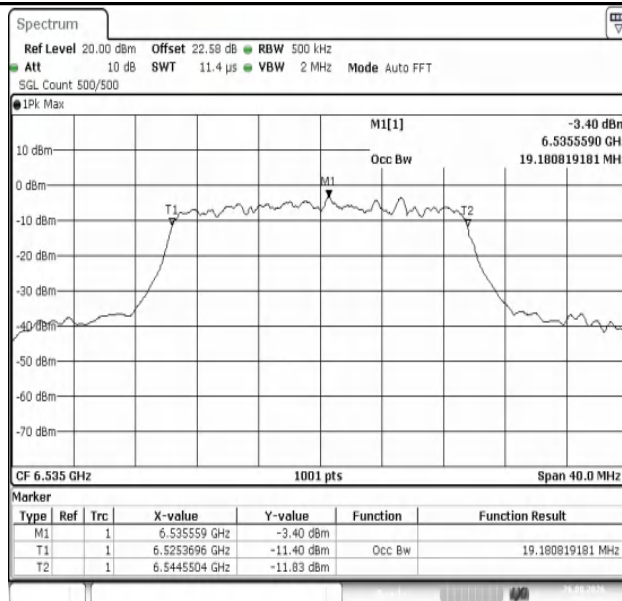

11AX20MIMO-Ant1-6535-PASS

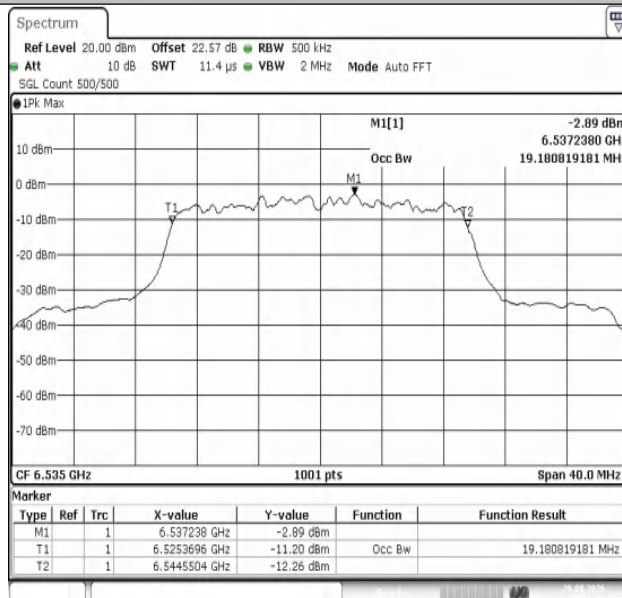



11AX20MIMO-Ant2-6535-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

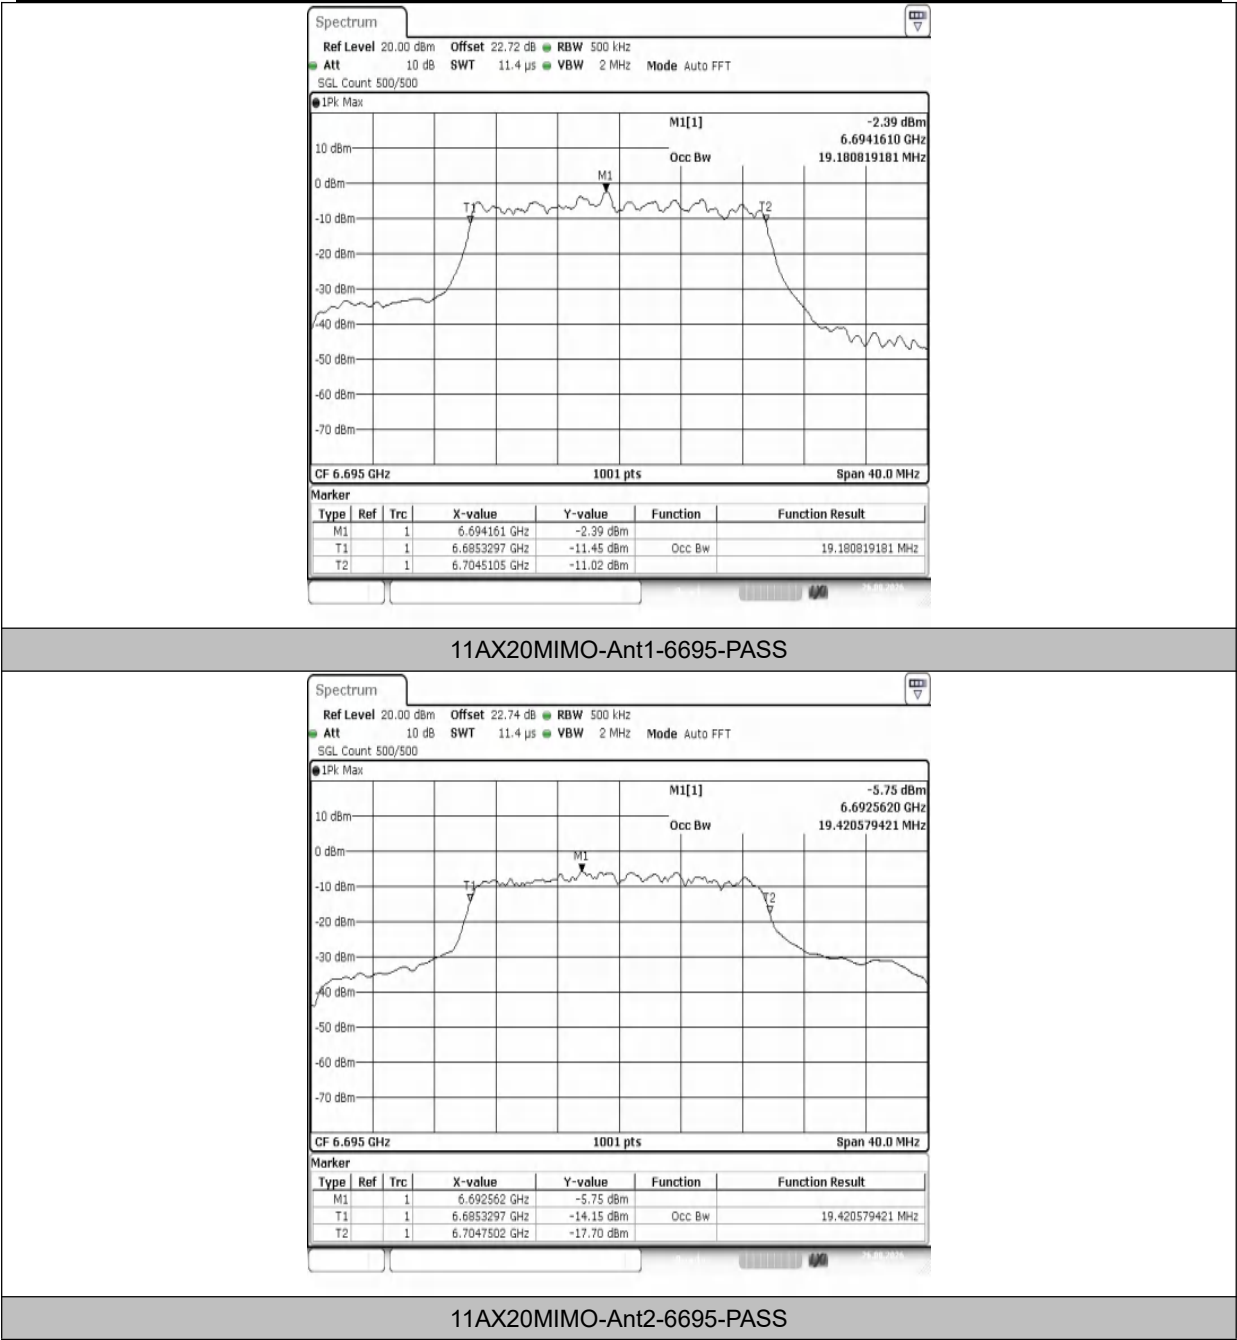

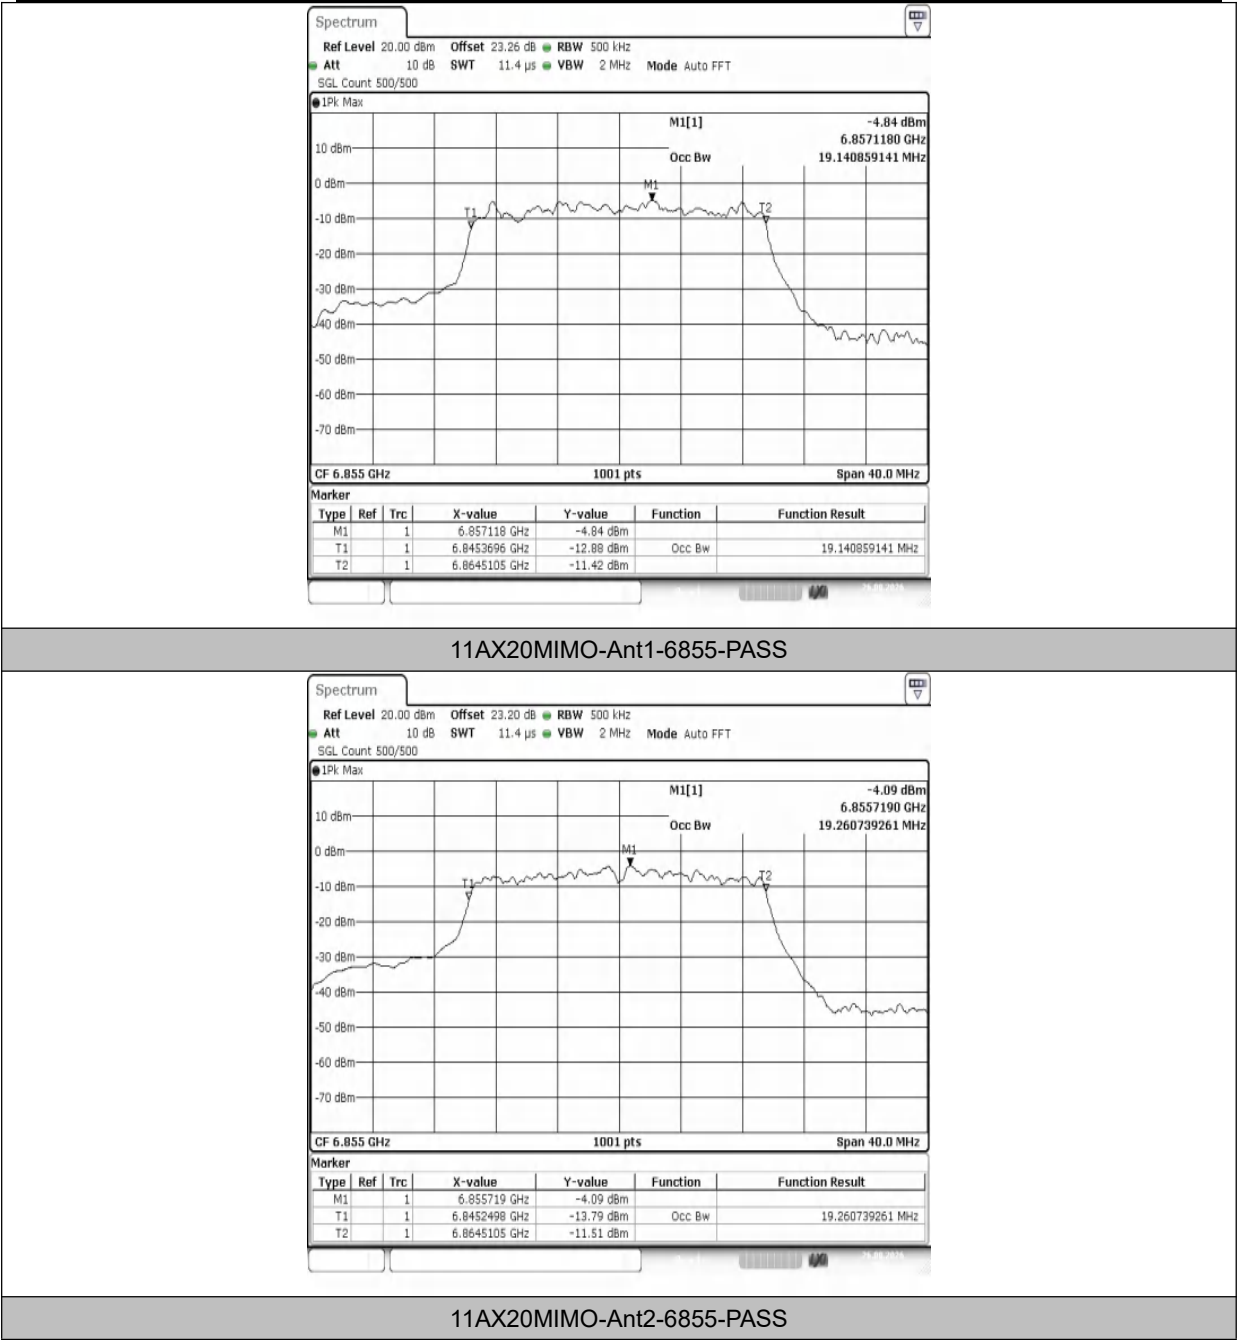


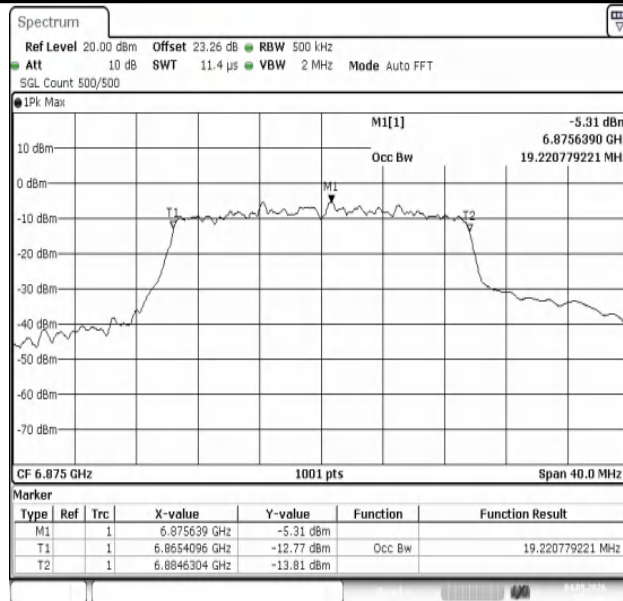


11AX20MIMO-Ant1-6875-PASS

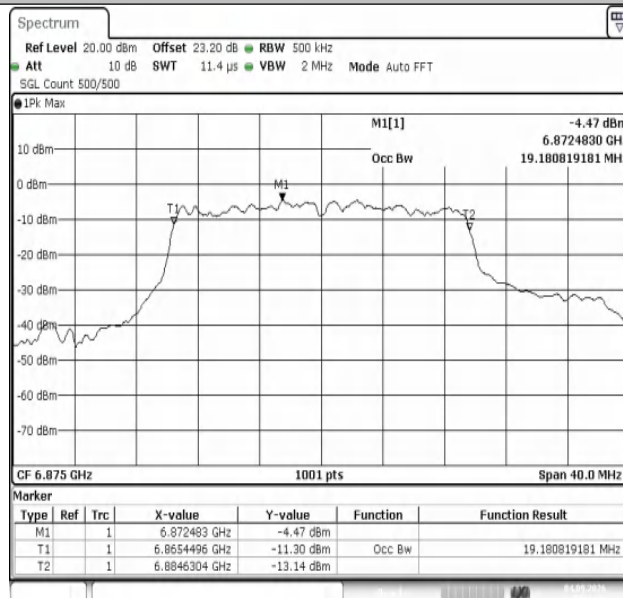

11AX20MIMO-Ant2-6875-PASS

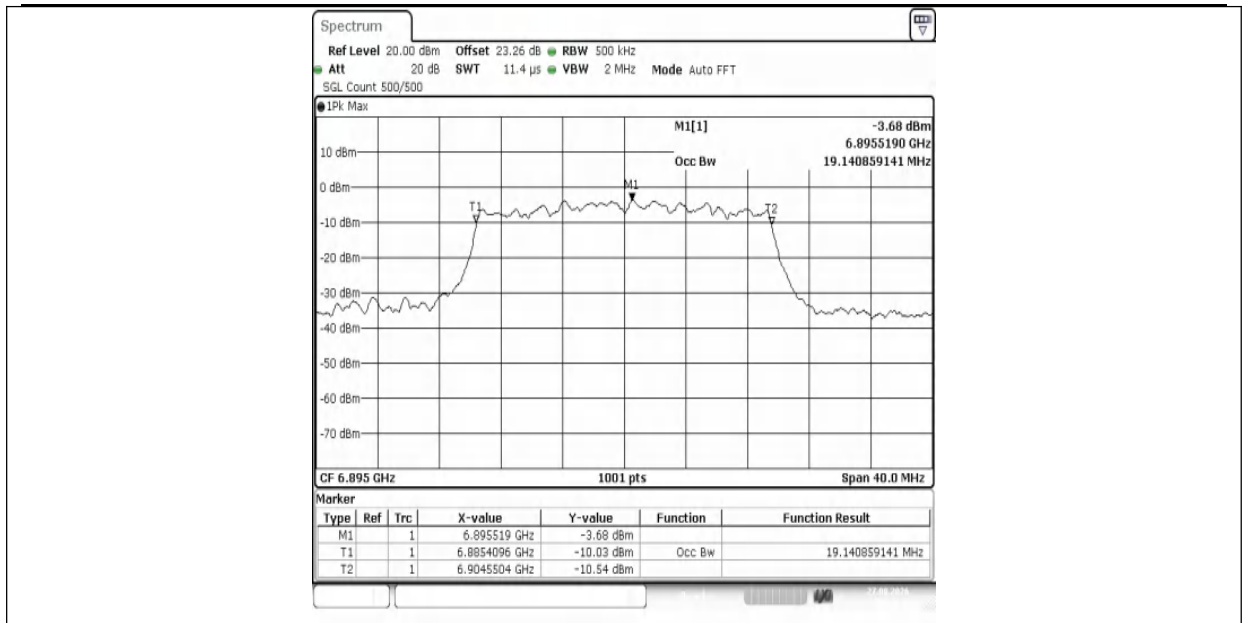

11AX20MIMO-Ant1-6895-PASS

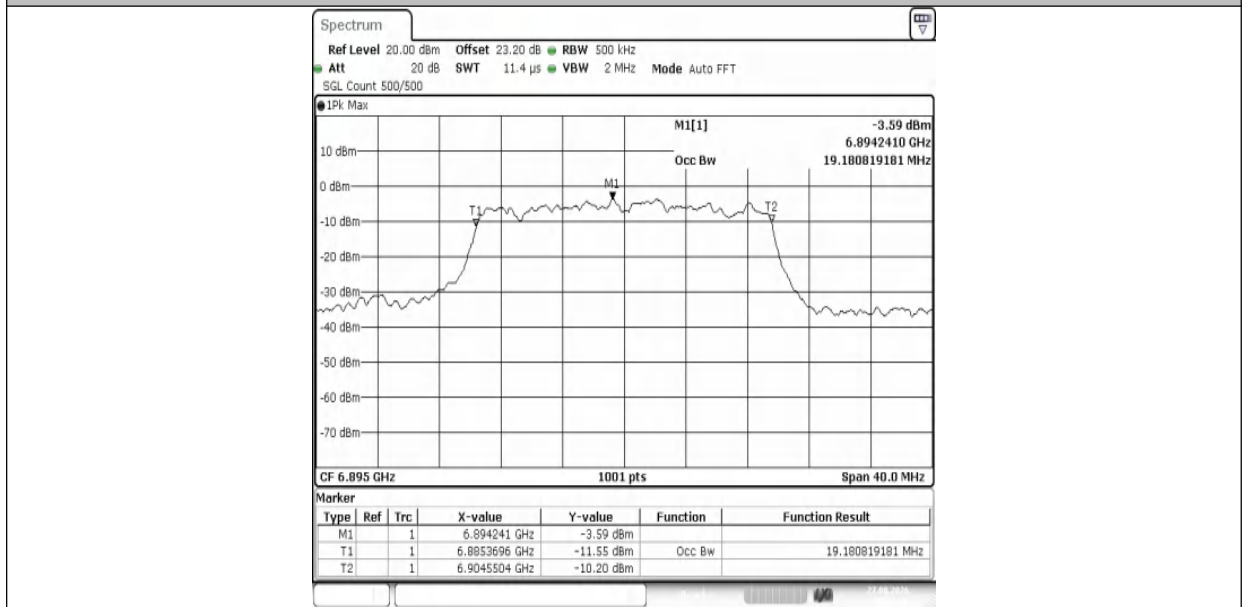



11AX20MIMO-Ant2-6895-PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

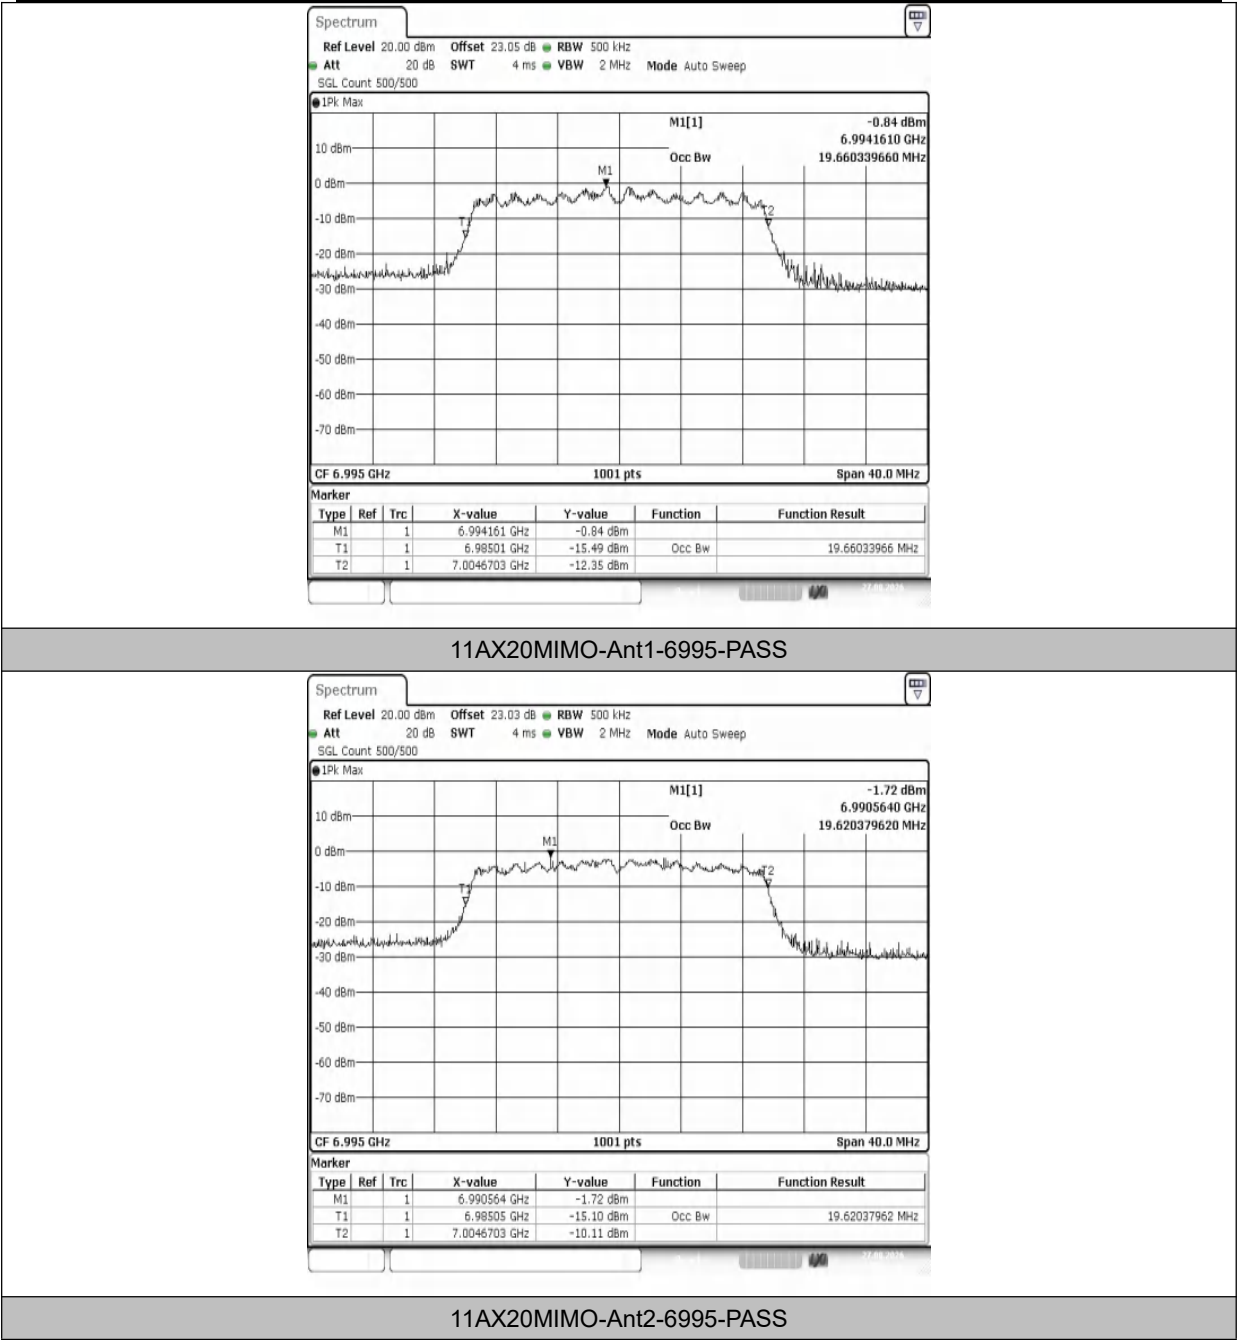

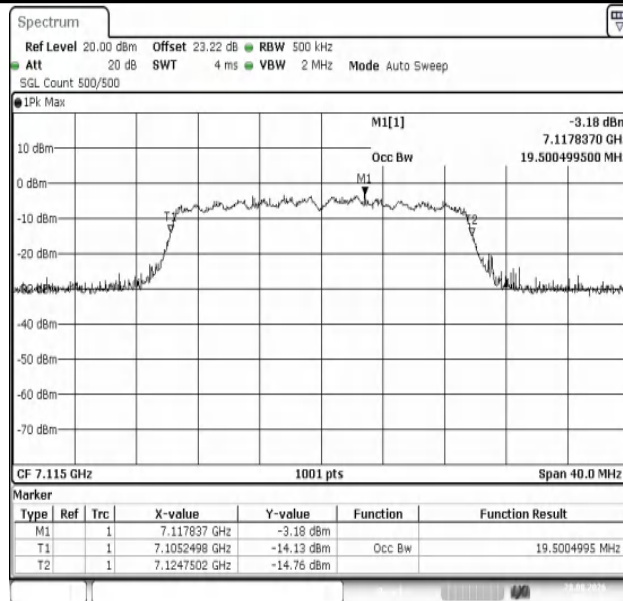

11AX20MIMO-Ant1-7115-PASS

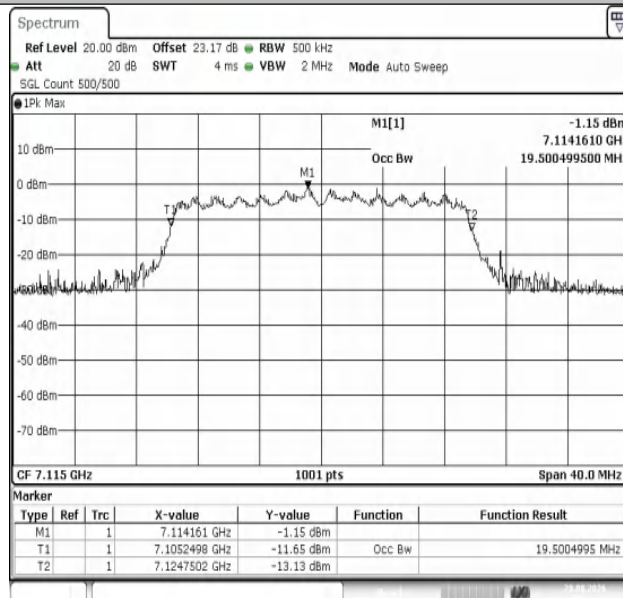


11AX20MIMO-Ant2-7115-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

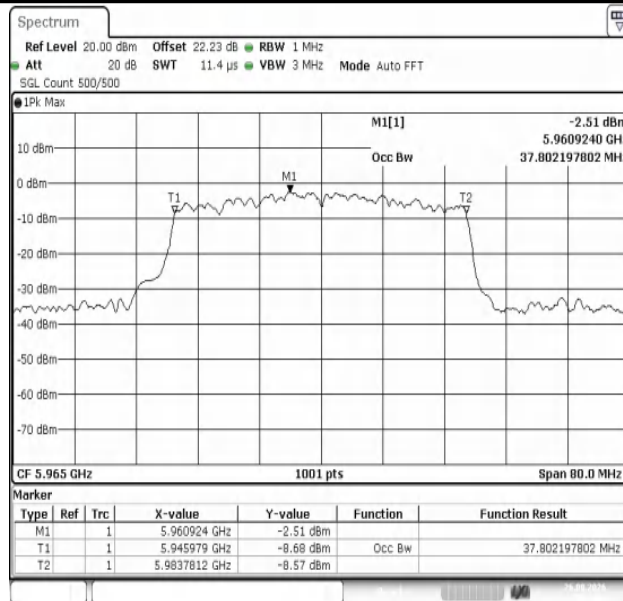


11AX40MIMO-Ant1-5965-PASS

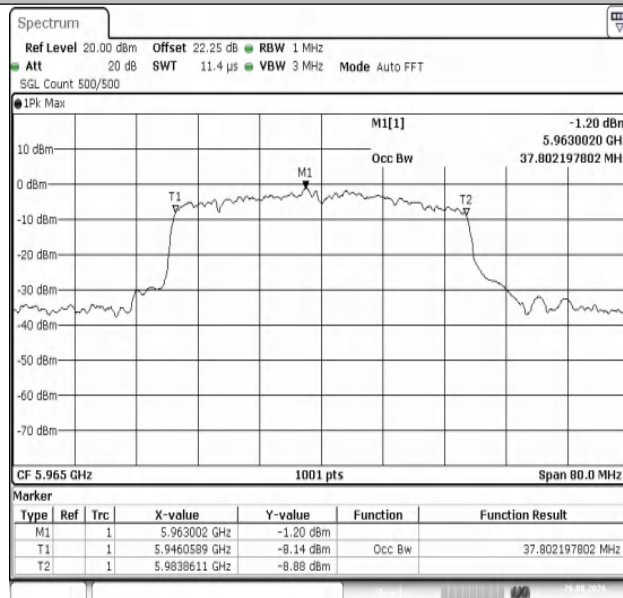

11AX40MIMO-Ant2-5965-PASS

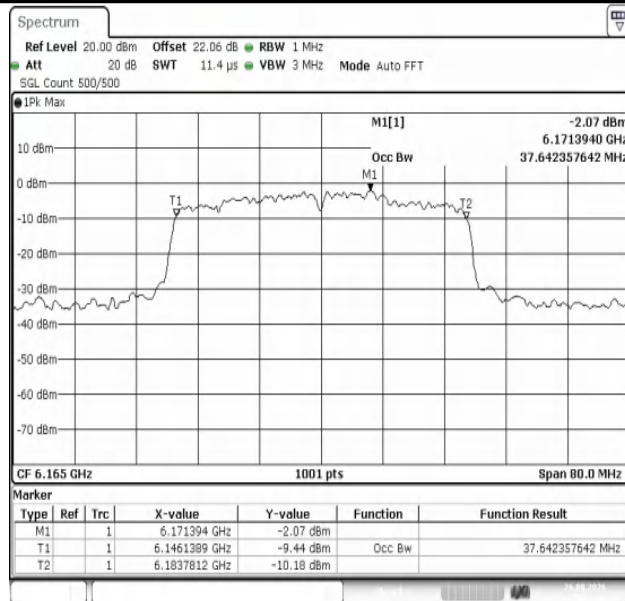

11AX40MIMO-Ant1-6165-PASS

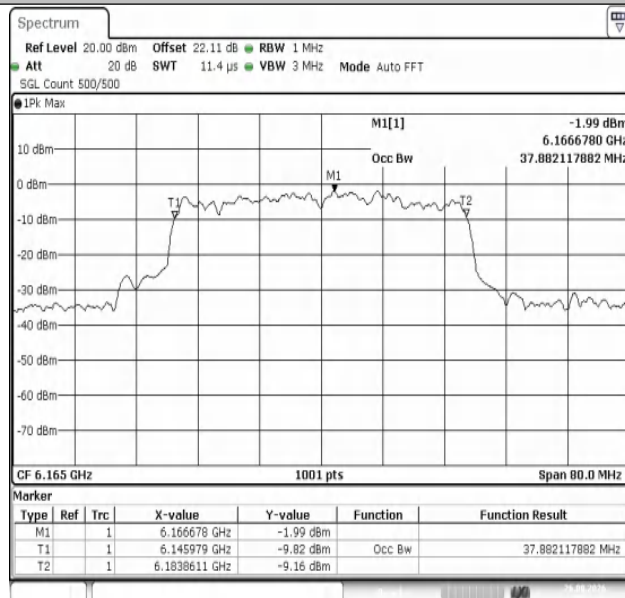


11AX40MIMO-Ant2-6165-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

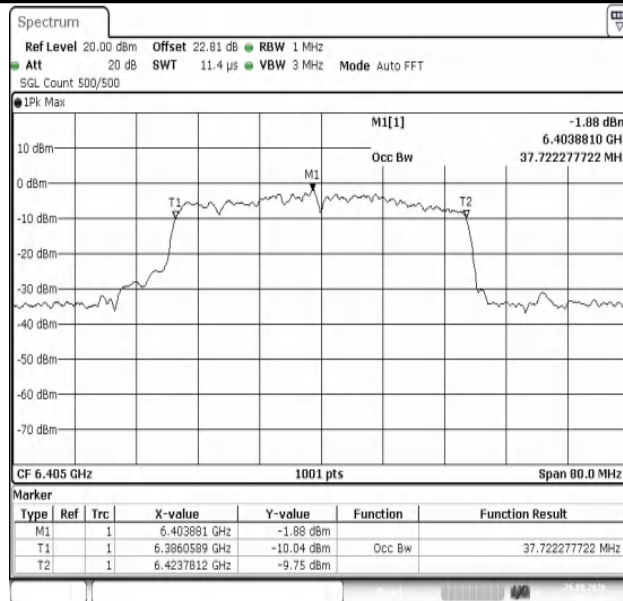

11AX40MIMO-Ant1-6405-PASS

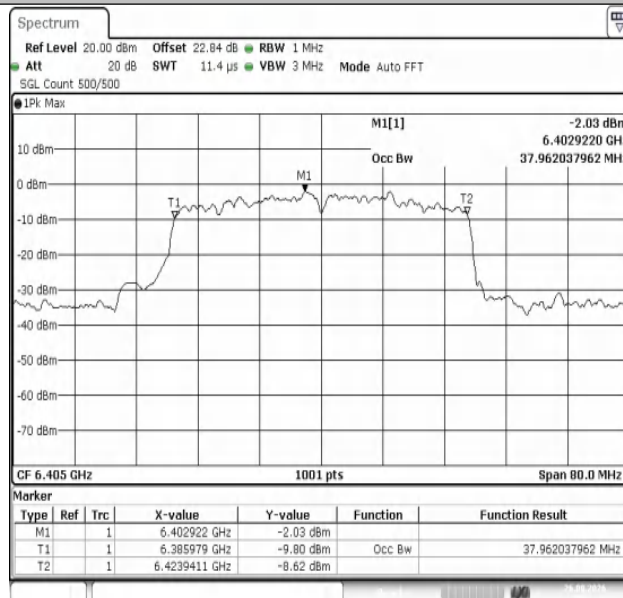



11AX40MIMO-Ant2-6405-PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

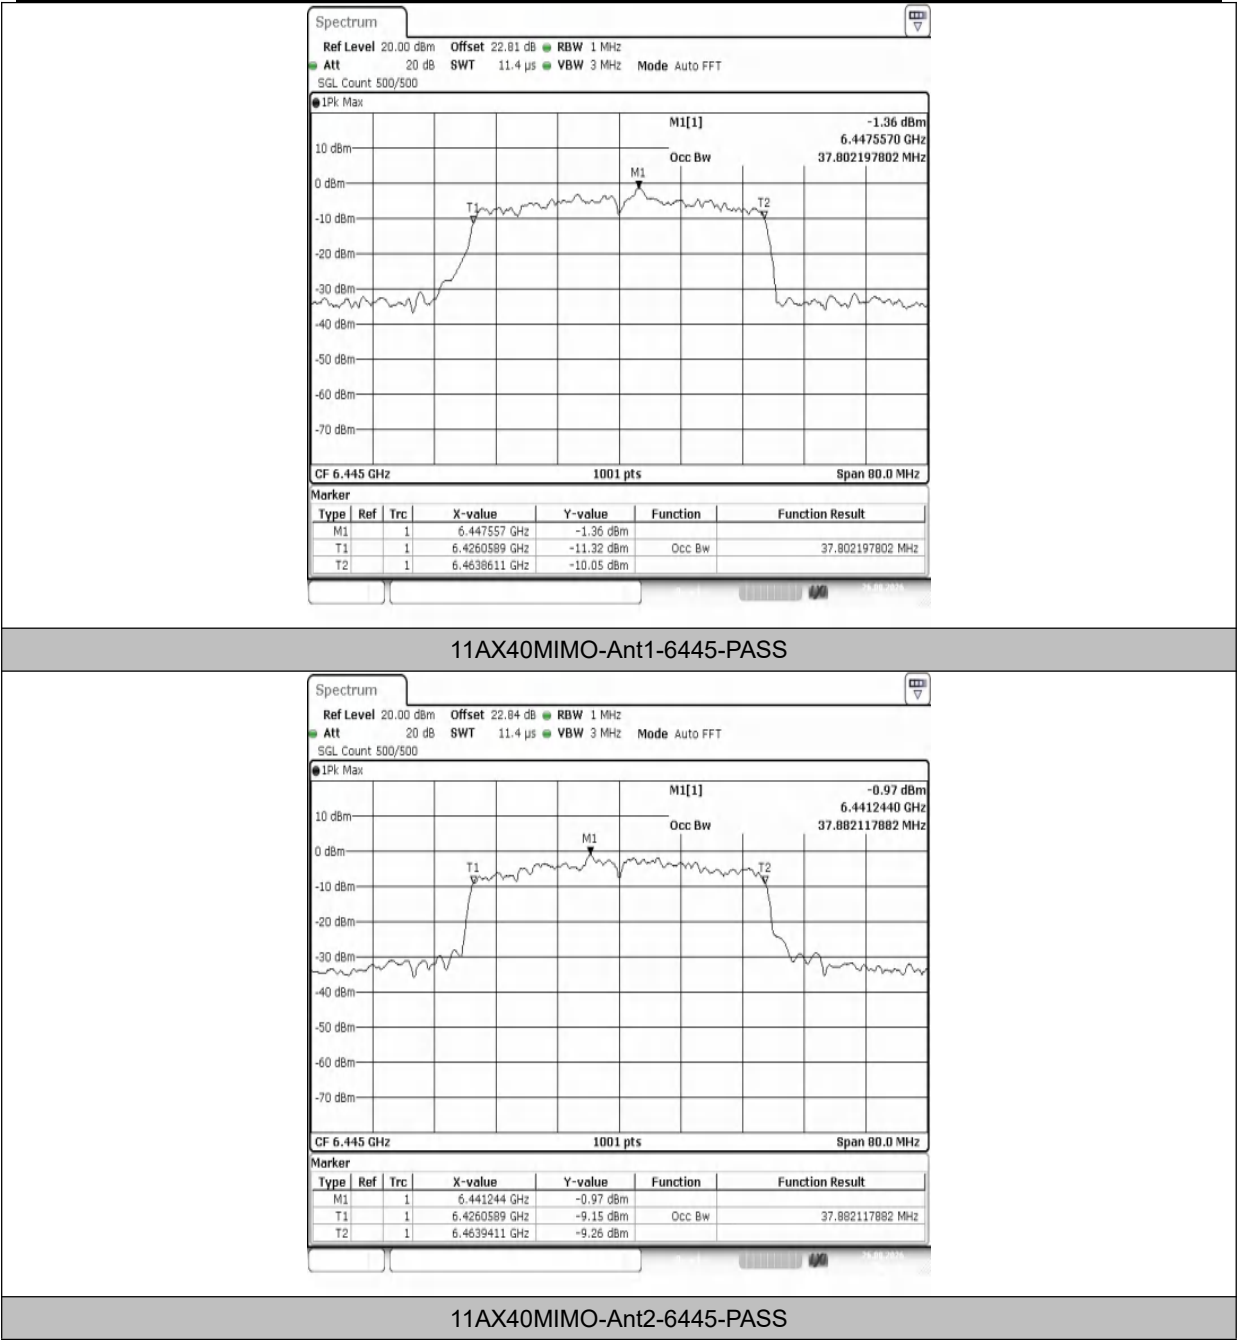

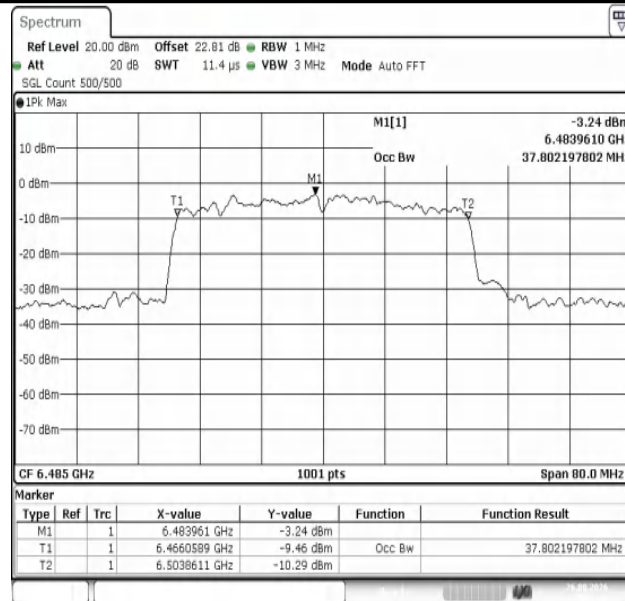

11AX40MIMO-Ant1-6485-PASS

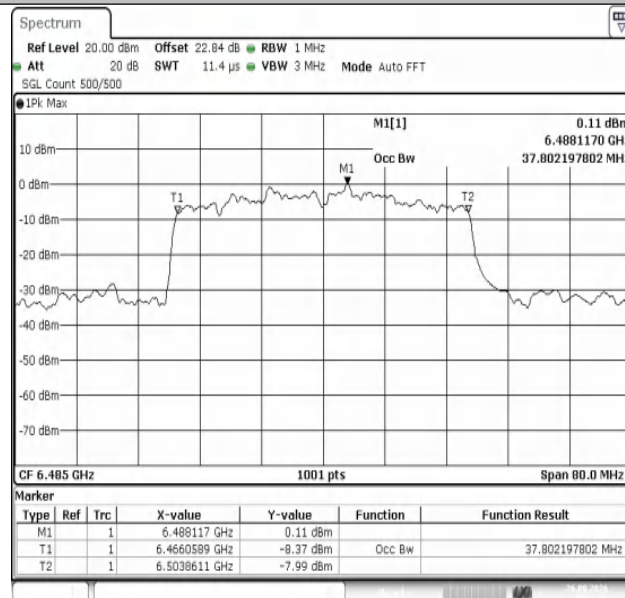


11AX40MIMO-Ant2-6485-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

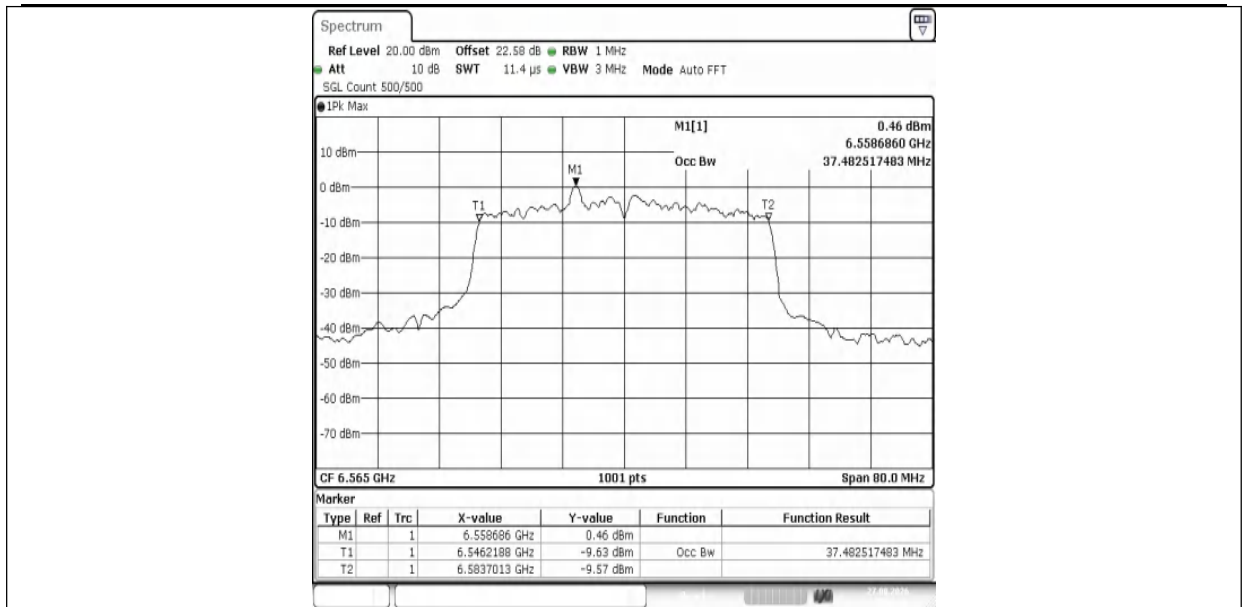

11AX40MIMO-Ant1-6565-PASS

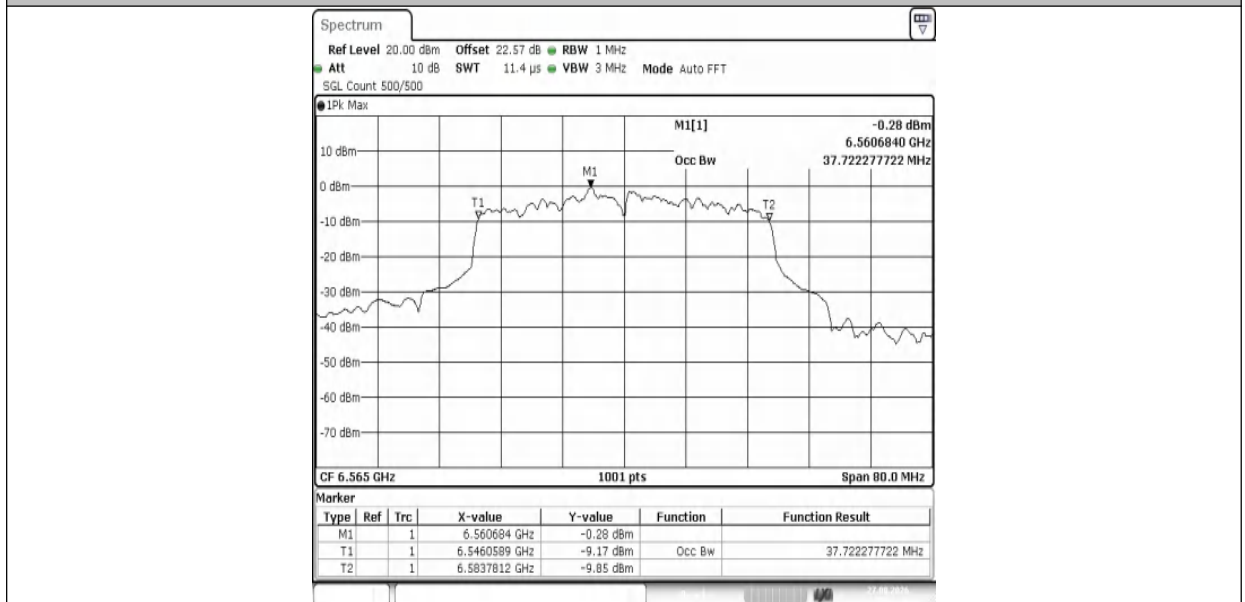


11AX40MIMO-Ant2-6565-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

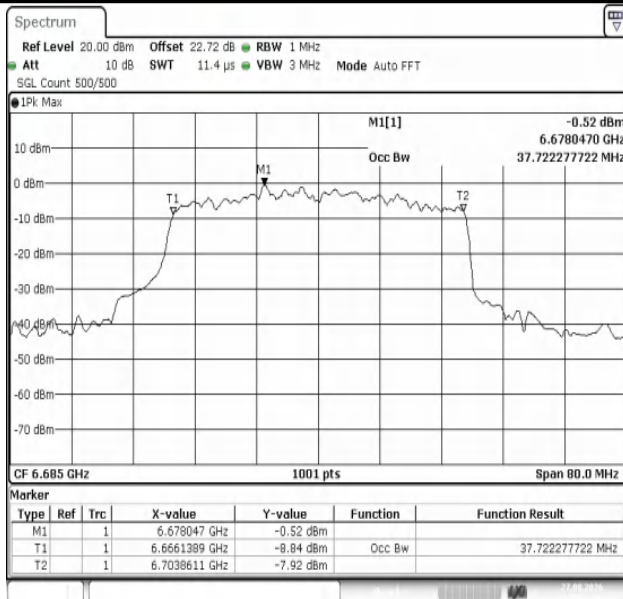

11AX40MIMO-Ant1-6685-PASS

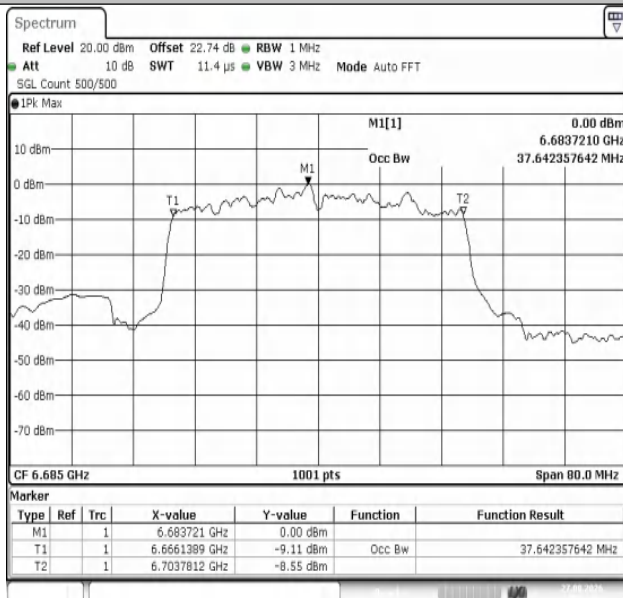


11AX40MIMO-Ant2-6685-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

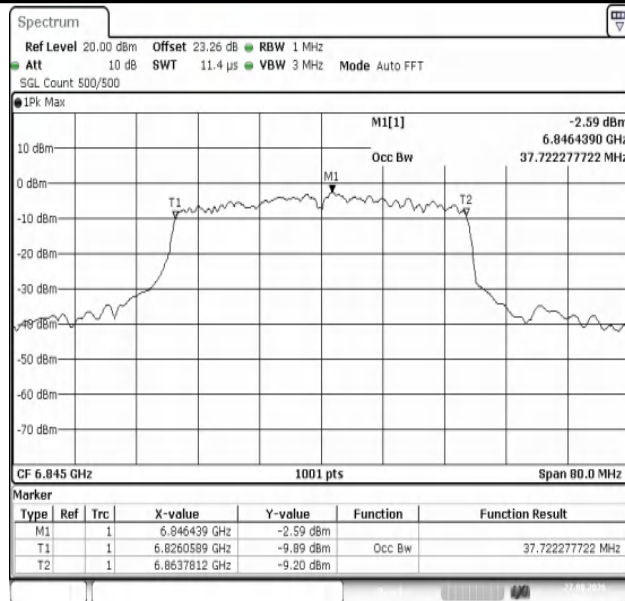


11AX40MIMO-Ant1-6845-PASS

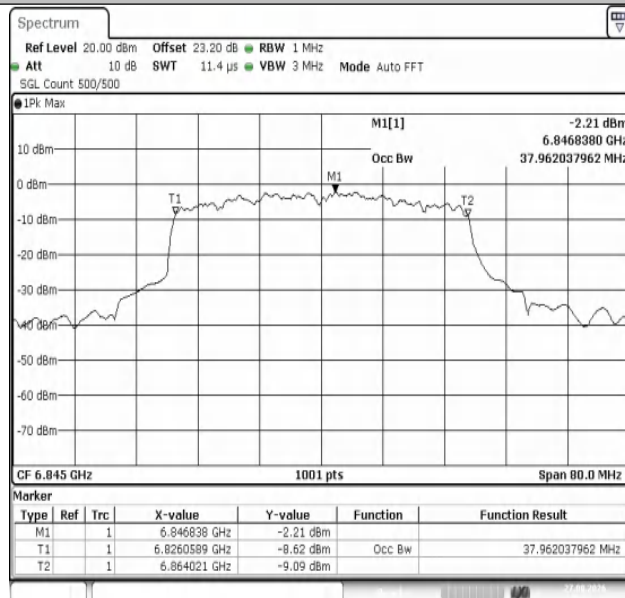

11AX40MIMO-Ant2-6845-PASS

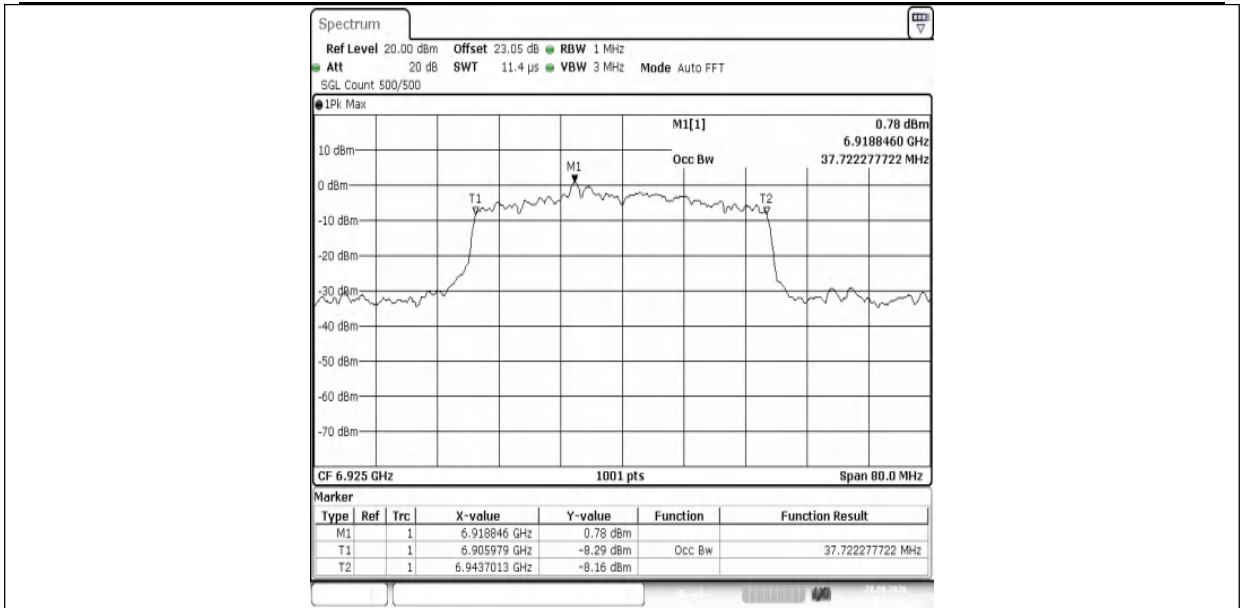

11AX40MIMO-Ant1-6925-PASS

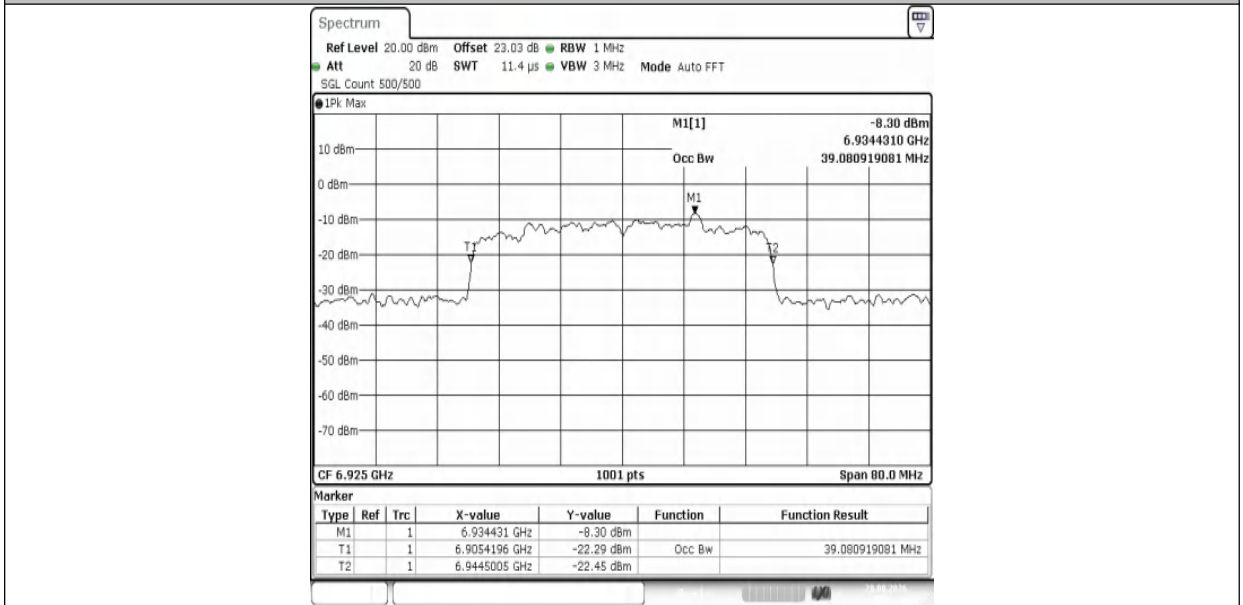


11AX40MIMO-Ant2-6925-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

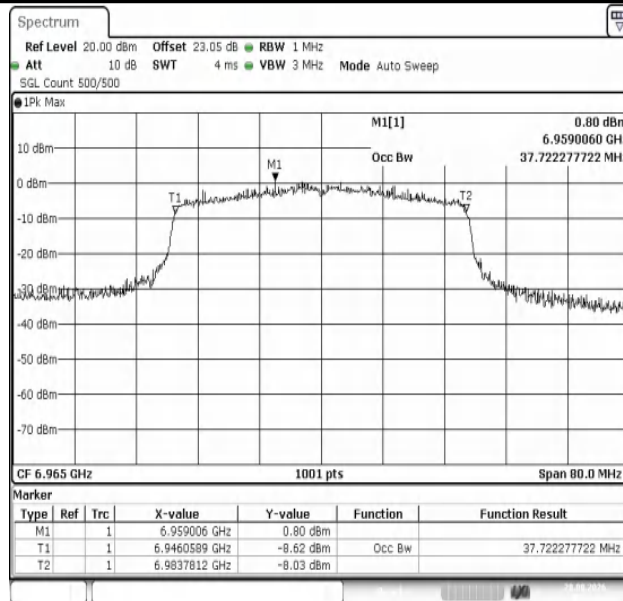

11AX40MIMO-Ant1-6965-PASS

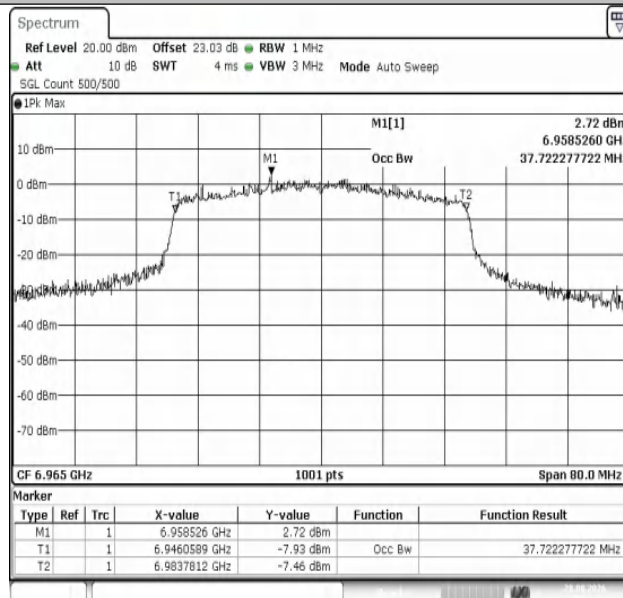


11AX40MIMO-Ant2-6965-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

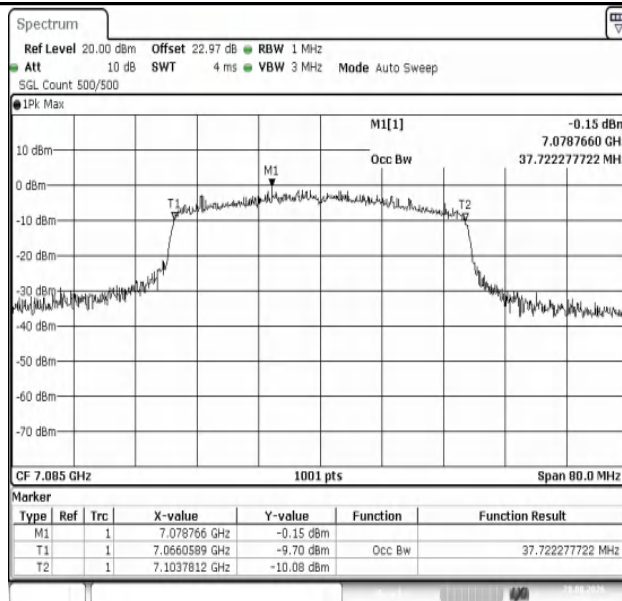

11AX40MIMO-Ant1-7085-PASS

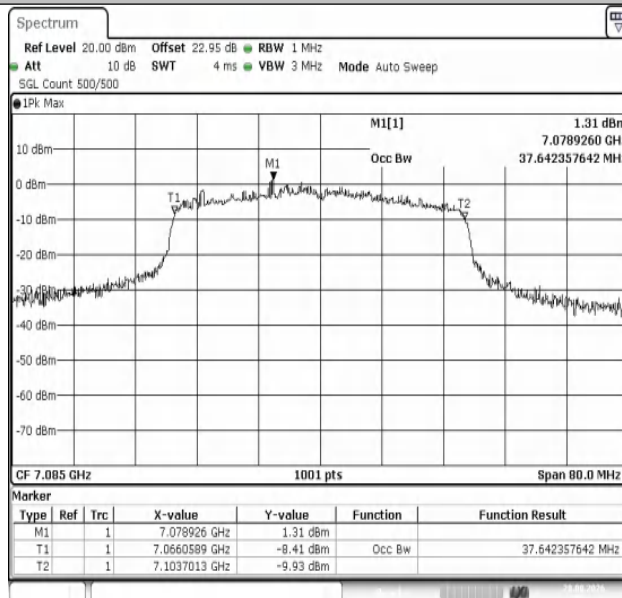


11AX40MIMO-Ant2-7085-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

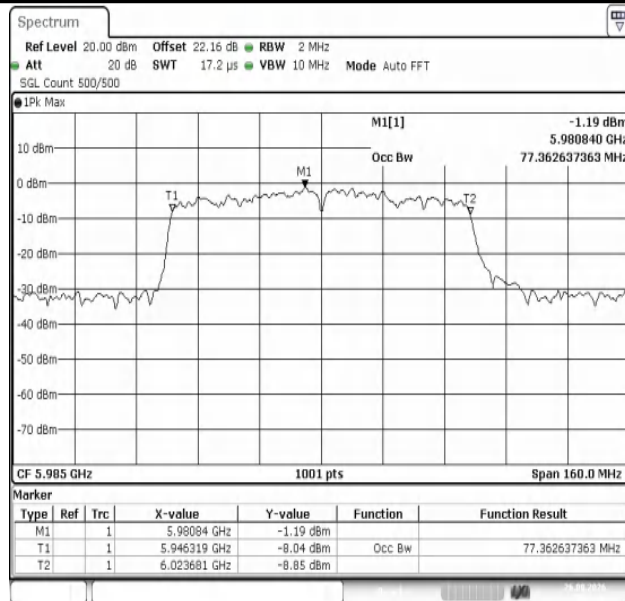

11AX80MIMO-Ant1-5985-PASS

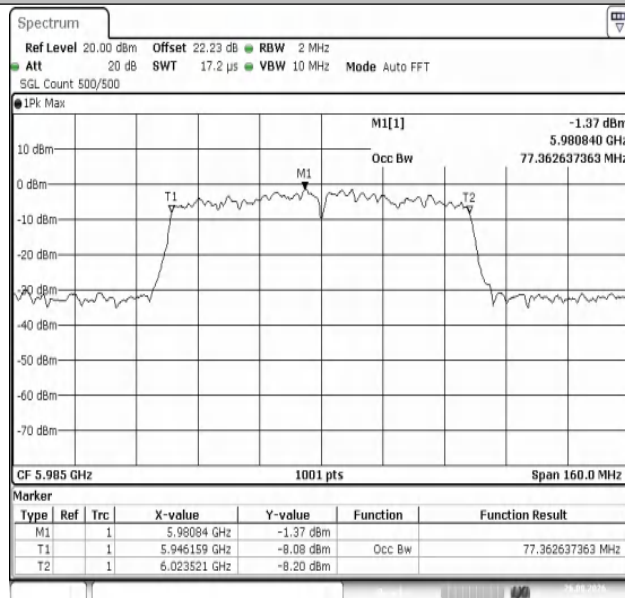


11AX80MIMO-Ant2-5985-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

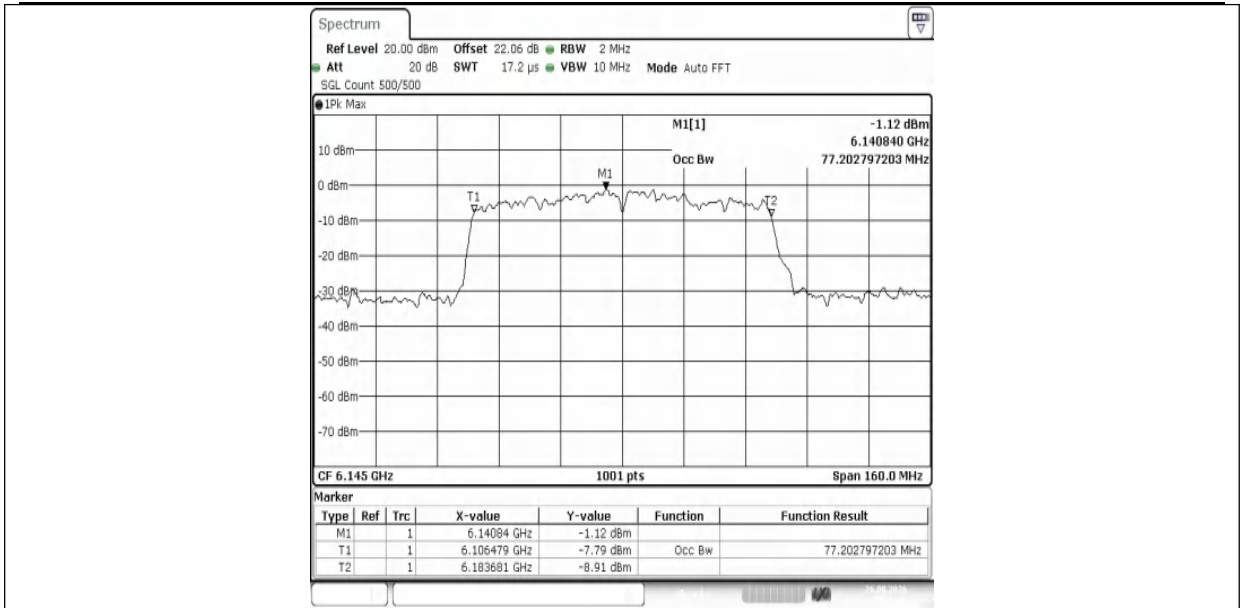

11AX80MIMO-Ant1-6145-PASS

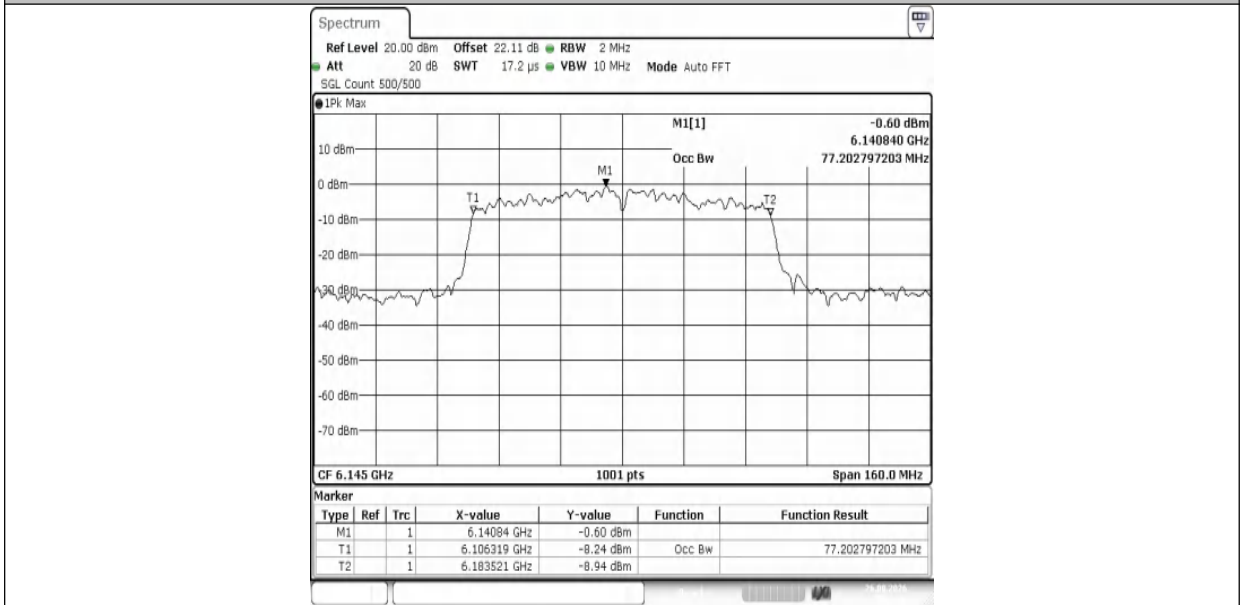



11AX80MIMO-Ant2-6145-PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

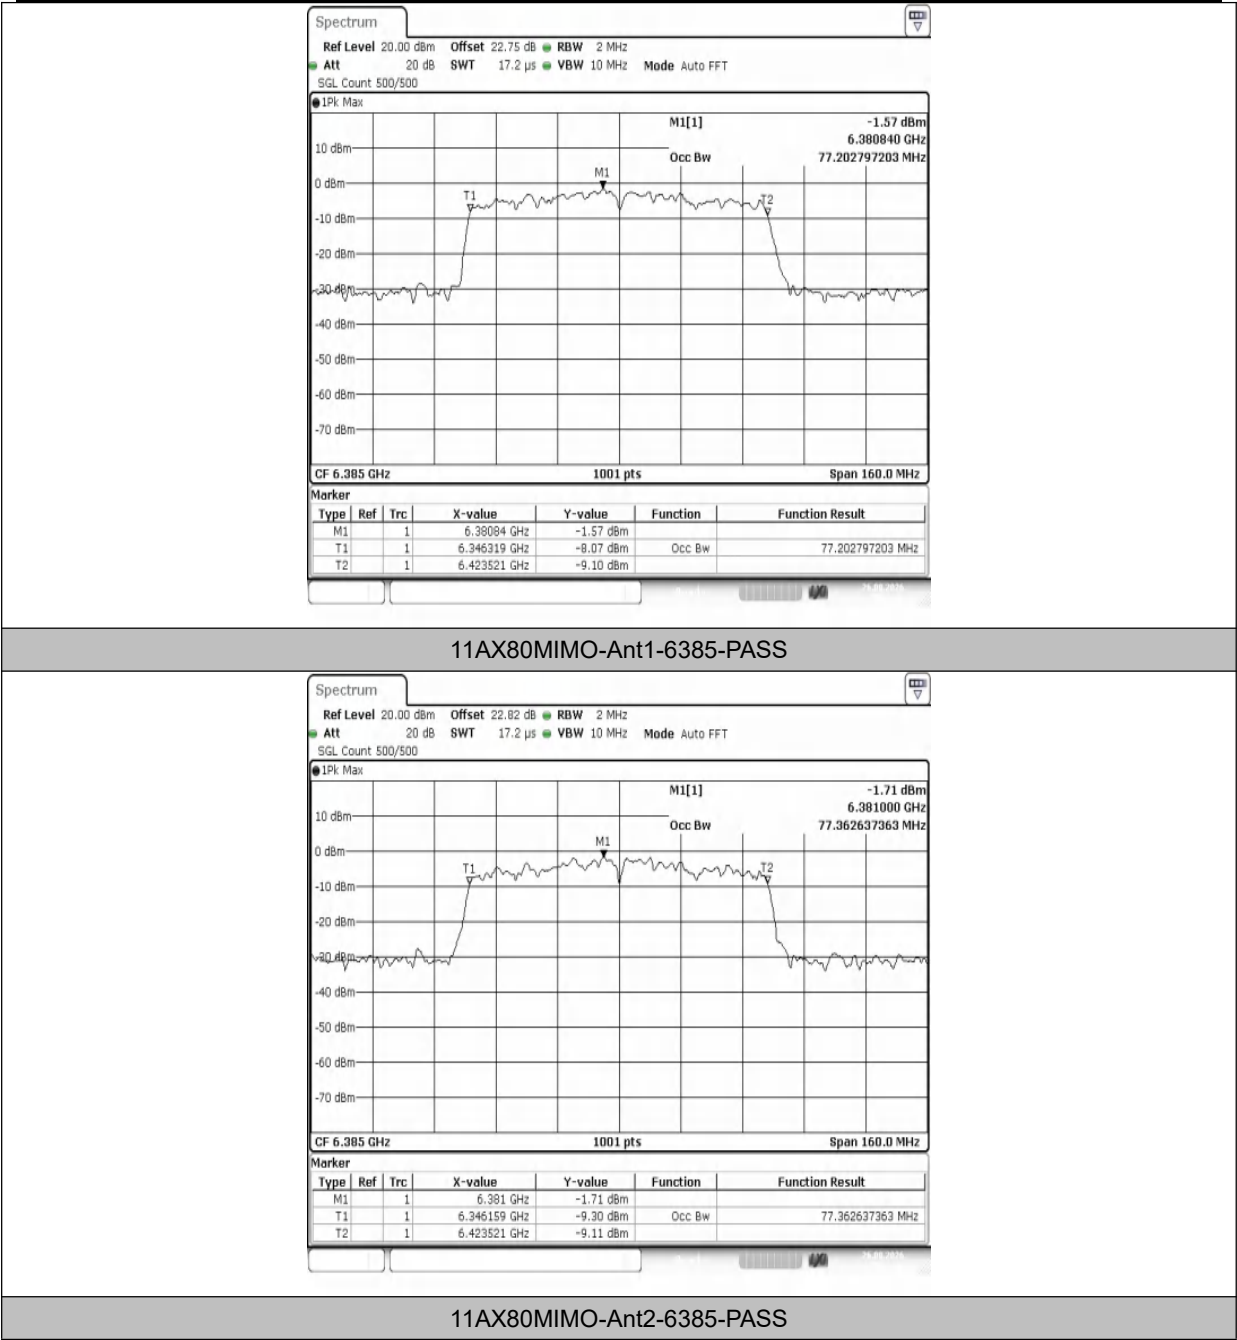

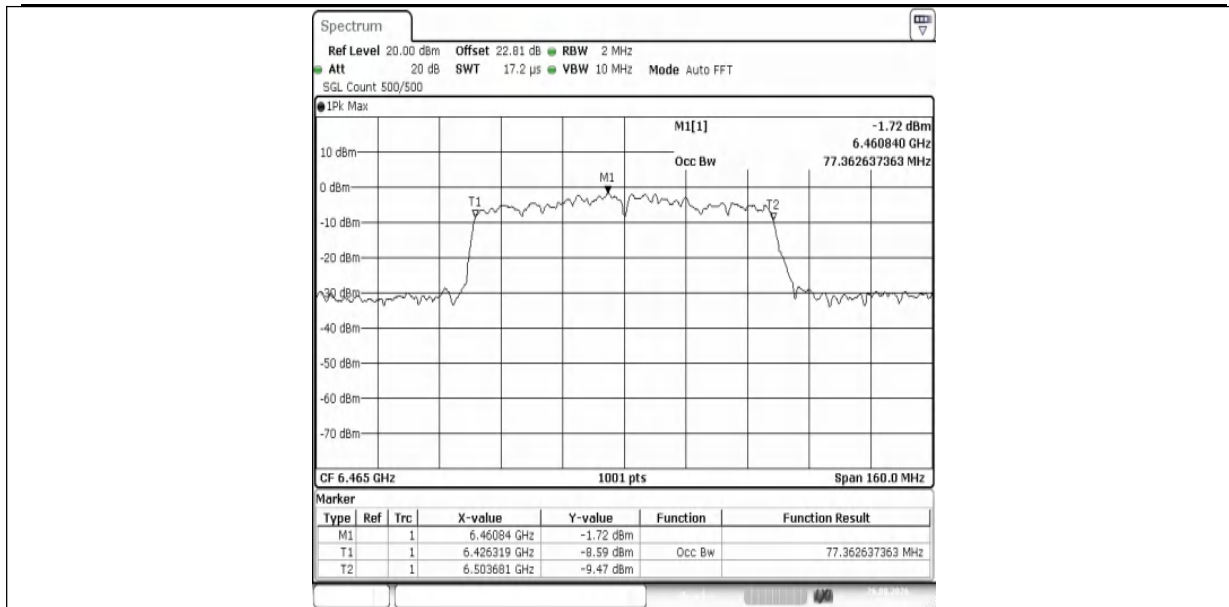

11AX80MIMO-Ant1-6465-PASS

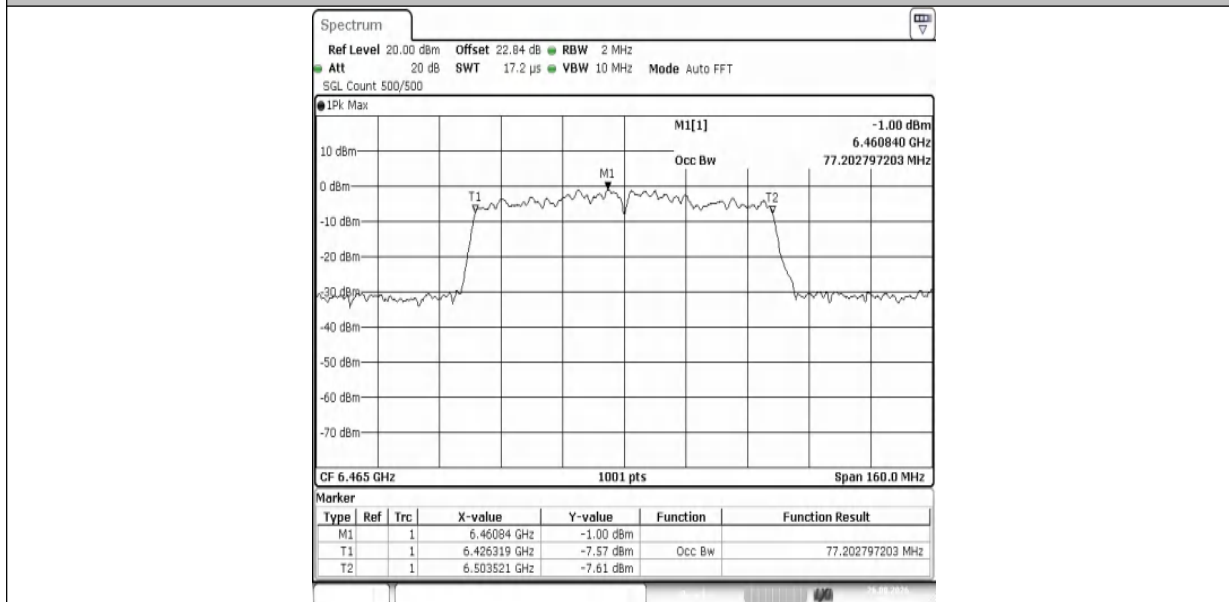


11AX80MIMO-Ant2-6465-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

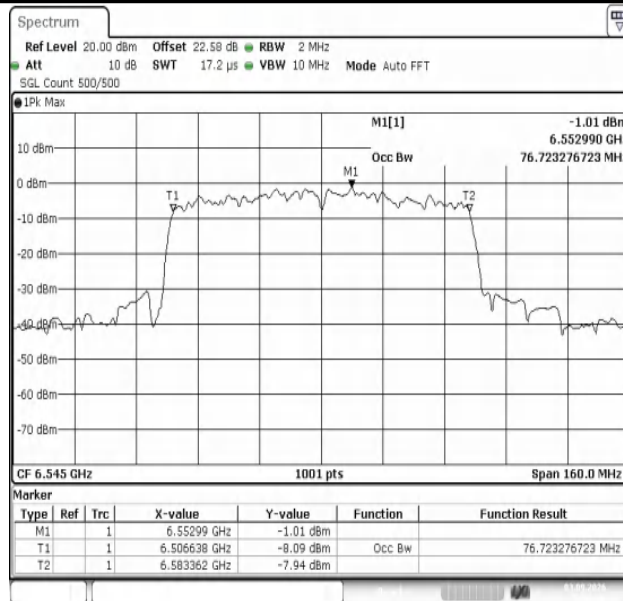


11AX80MIMO-Ant1-6545-PASS

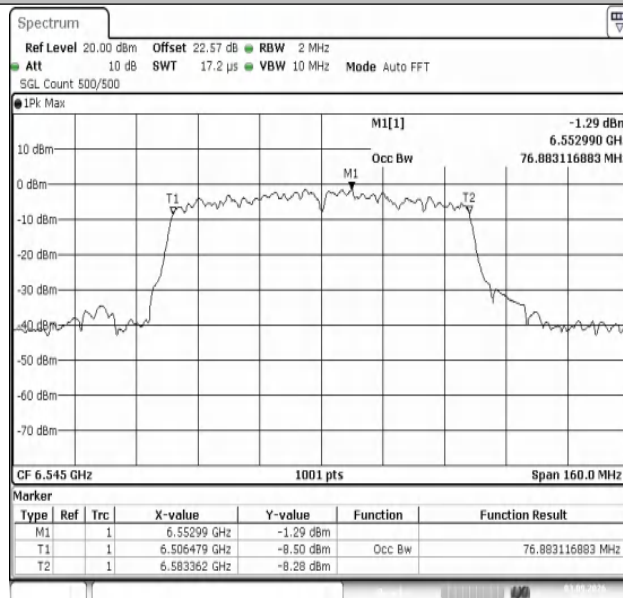

11AX80MIMO-Ant2-6545-PASS

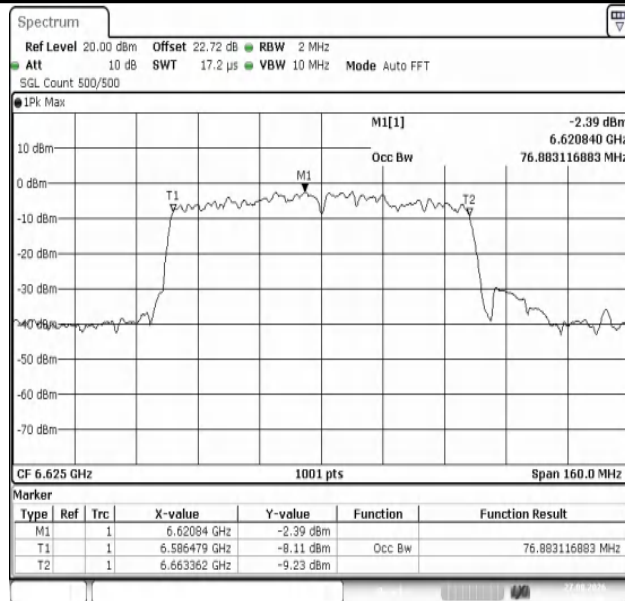

11AX80MIMO-Ant1-6625-PASS

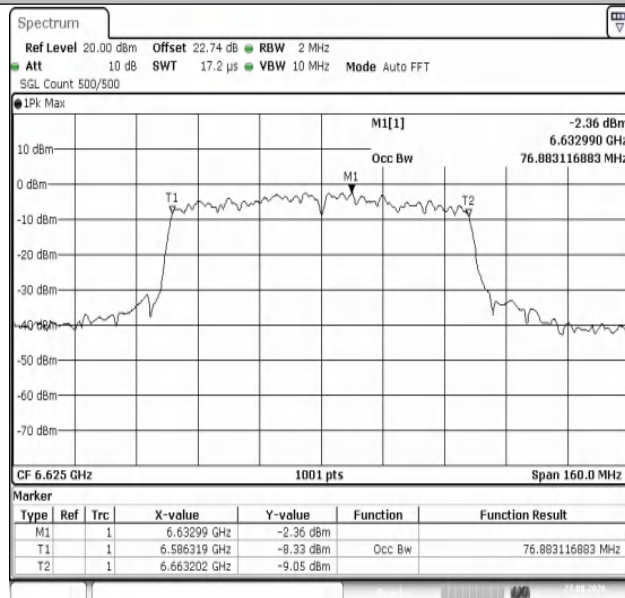


11AX80MIMO-Ant2-6625-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

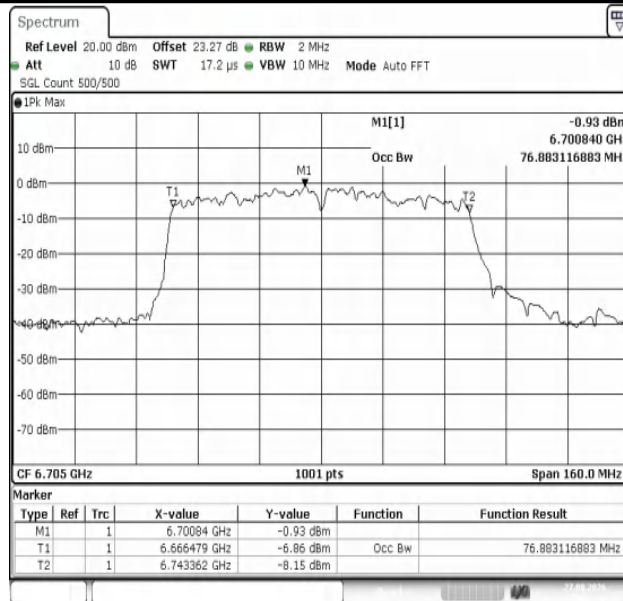

11AX80MIMO-Ant1-6705-PASS

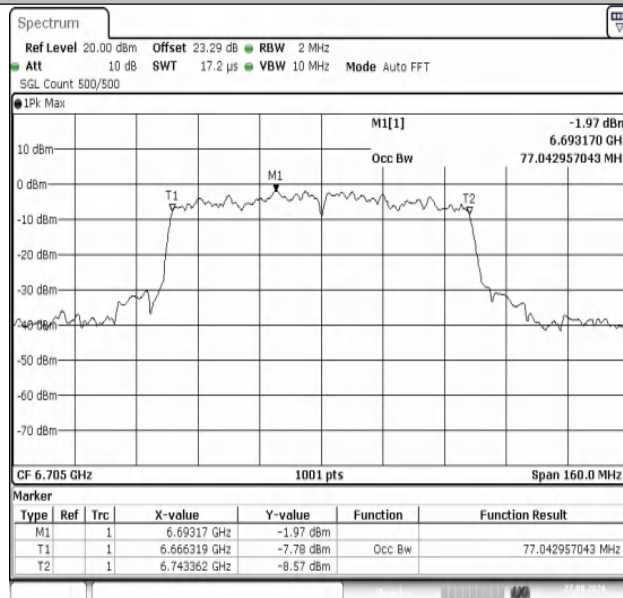



11AX80MIMO-Ant2-6705-PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

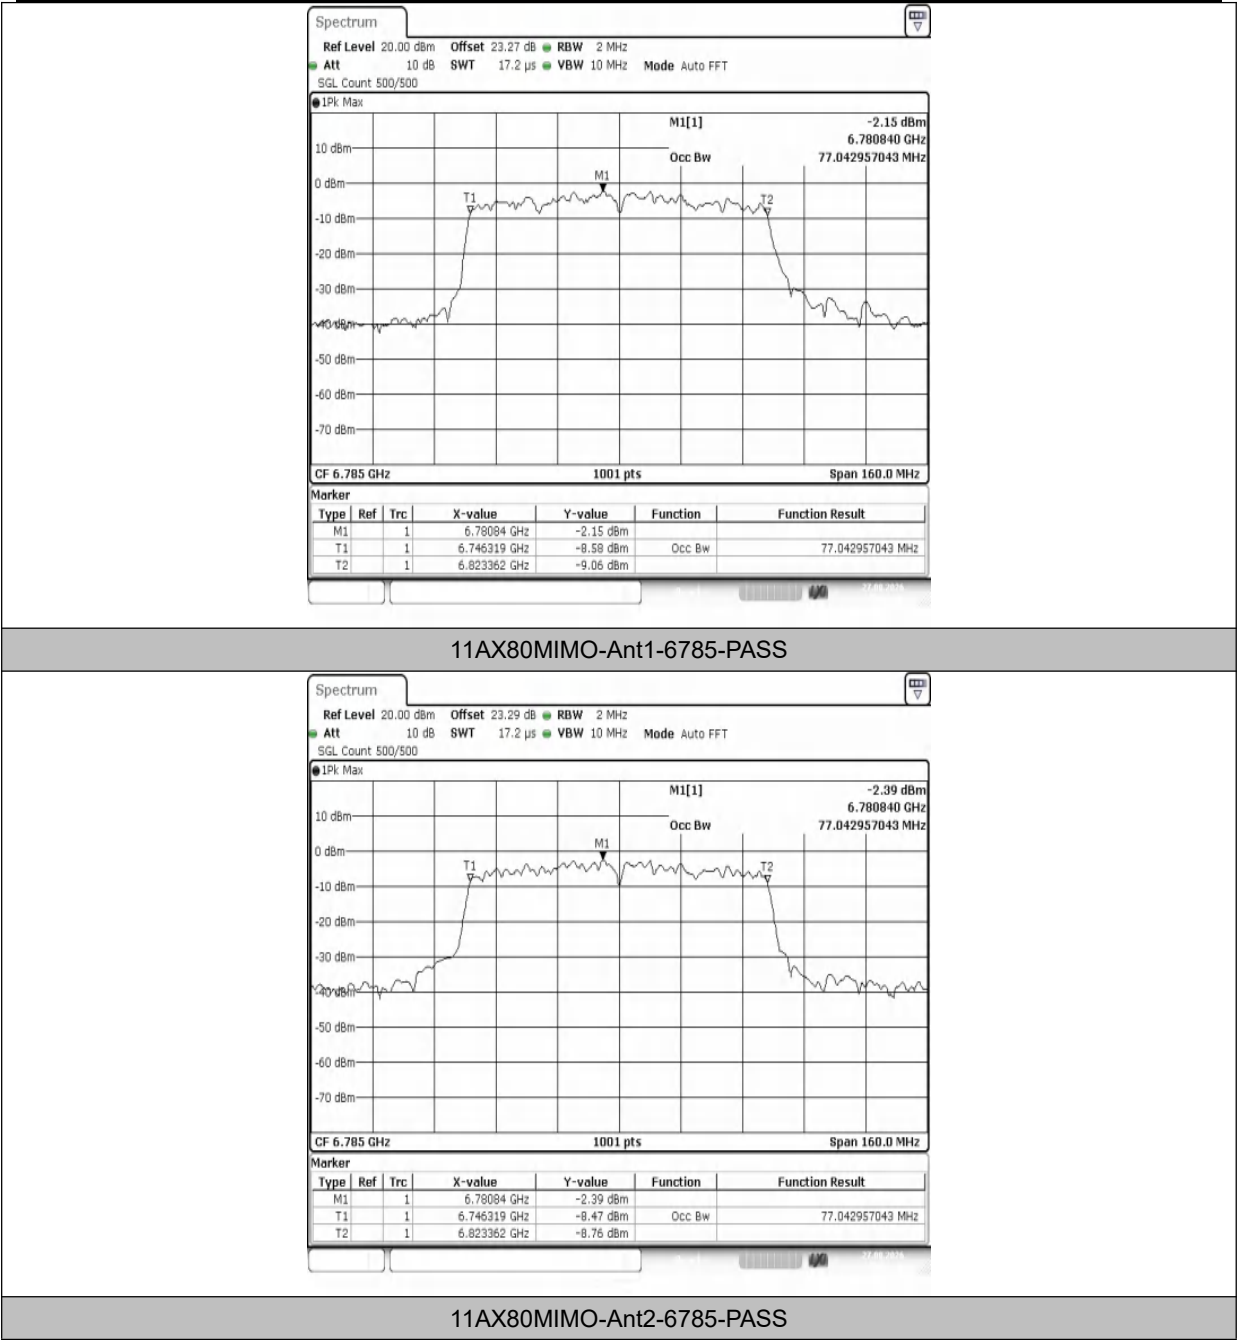

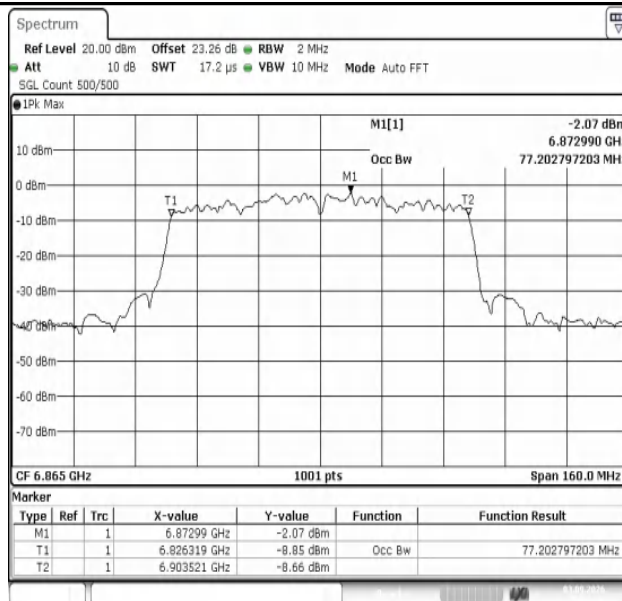

11AX80MIMO-Ant1-6865-PASS

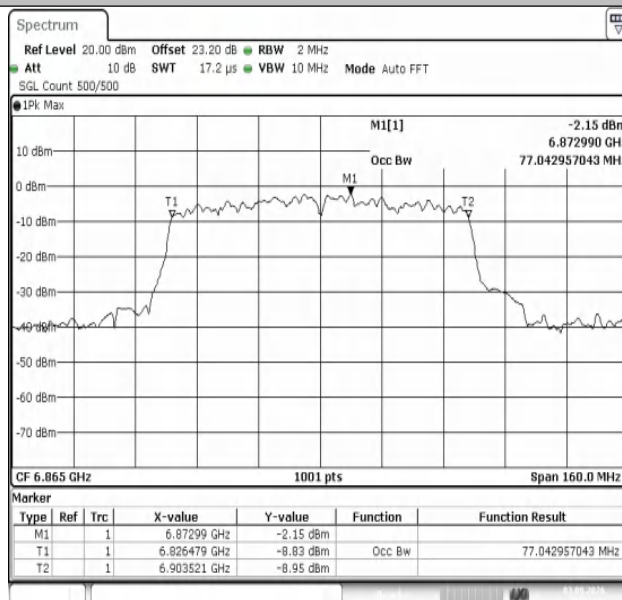


11AX80MIMO-Ant2-6865-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

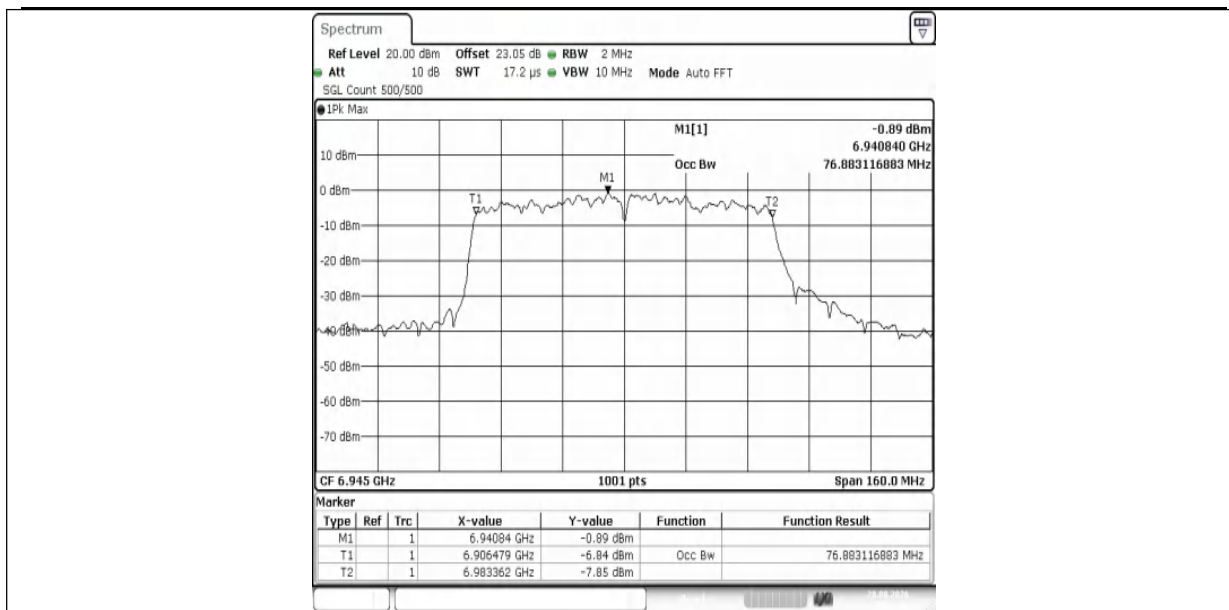

11AX80MIMO-Ant1-6945-PASS

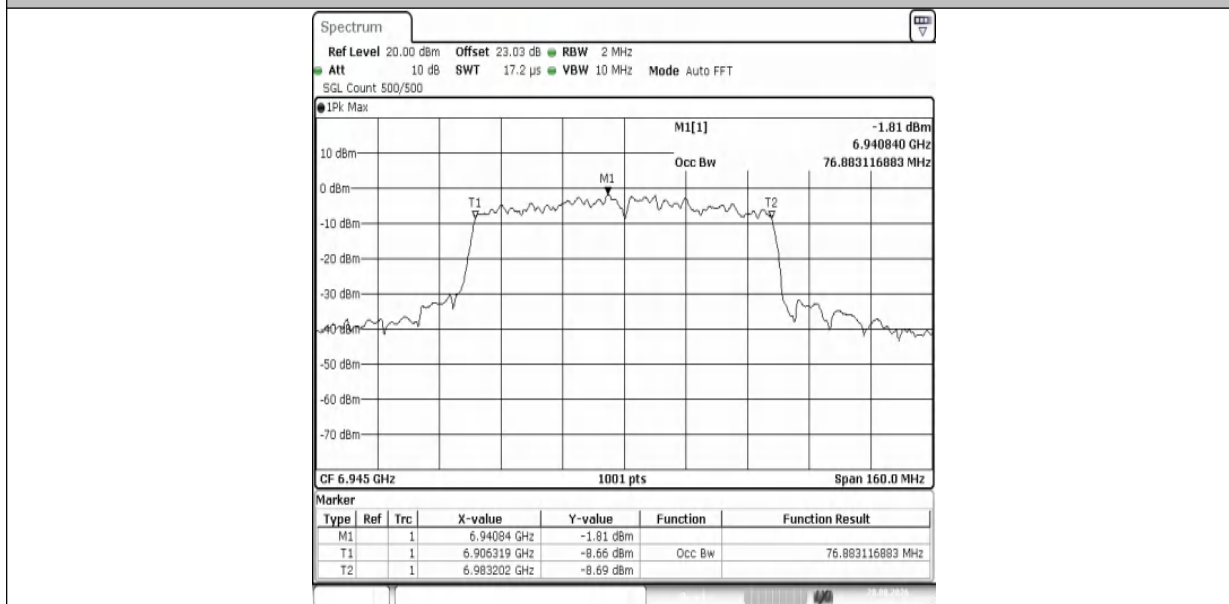


11AX80MIMO-Ant2-6945-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

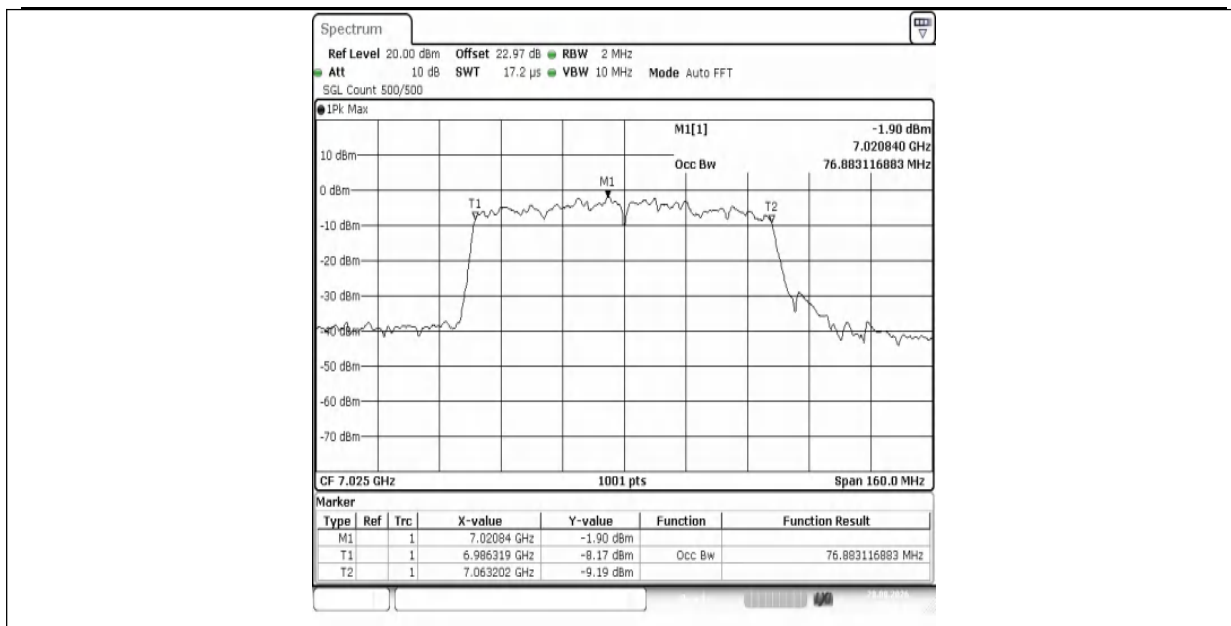

11AX80MIMO-Ant1-7025-PASS

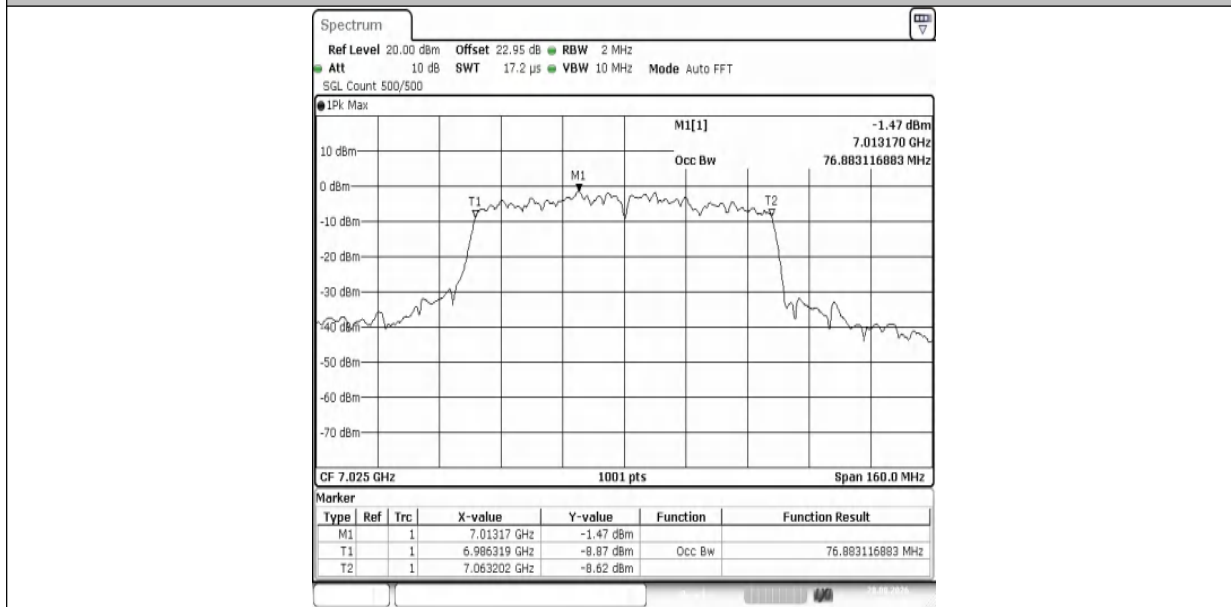

11AX80MIMO-Ant2-7025-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Duty Cycle

Test Result

TestMode	Antenna	Frequency [MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Limit	Verdict
11AX20MIMO	Ant1	5955	1.01	1.05	96.19	---	---
11AX20MIMO	Ant2	5955	1.02	1.05	97.14	---	---
11AX20MIMO	Ant1	6175	1.01	1.05	96.19	---	---
11AX20MIMO	Ant2	6175	1.01	1.05	96.19	---	---
11AX20MIMO	Ant1	6415	1.01	1.05	96.19	---	---
11AX20MIMO	Ant2	6415	1.02	1.05	97.14	---	---
11AX20MIMO	Ant1	6435	1.01	1.05	96.19	---	---
11AX20MIMO	Ant2	6435	1.01	1.05	96.19	---	---
11AX20MIMO	Ant1	6475	1.01	1.05	96.19	---	---
11AX20MIMO	Ant2	6475	1.01	1.05	96.19	---	---
11AX20MIMO	Ant1	6515	1.01	1.05	96.19	---	---
11AX20MIMO	Ant2	6515	1.01	1.05	96.19	---	---
11AX20MIMO	Ant1	6535	1.01	1.05	96.19	---	---
11AX20MIMO	Ant2	6535	1.01	1.05	96.19	---	---
11AX20MIMO	Ant1	6695	1.01	1.05	96.19	---	---
11AX20MIMO	Ant2	6695	1.01	1.05	96.19	---	---
11AX20MIMO	Ant1	6855	1.01	1.05	96.19	---	---
11AX20MIMO	Ant2	6855	1.01	1.05	96.19	---	---
11AX20MIMO	Ant1	6875	1.02	1.05	97.14	---	---
11AX20MIMO	Ant2	6875	1.01	1.05	96.19	---	---
11AX20MIMO	Ant1	6895	1.02	1.05	97.14	---	---
11AX20MIMO	Ant2	6895	1.02	1.05	97.14	---	---
11AX20MIMO	Ant1	6995	1.01	1.05	96.19	---	---
11AX20MIMO	Ant2	6995	1.02	1.05	97.14	---	---
11AX20MIMO	Ant1	7115	1.01	1.05	96.19	---	---
11AX20MIMO	Ant2	7115	1.01	1.05	96.19	---	---
11AX40MIMO	Ant1	5965	0.07	0.09	77.78	---	---
11AX40MIMO	Ant2	5965	0.06	0.08	75.00	---	---
11AX40MIMO	Ant1	6165	0.07	0.09	77.78	---	---
11AX40MIMO	Ant2	6165	0.06	0.08	75.00	---	---
11AX40MIMO	Ant1	6405	0.06	0.08	75.00	---	---
11AX40MIMO	Ant2	6405	0.07	0.09	77.78	---	---
11AX40MIMO	Ant1	6445	0.06	0.08	75.00	---	---
11AX40MIMO	Ant2	6445	0.06	0.08	75.00	---	---
11AX40MIMO	Ant1	6485	0.07	0.09	77.78	---	---
11AX40MIMO	Ant2	6485	0.07	0.09	77.78	---	---
11AX40MIMO	Ant1	6565	0.07	0.09	77.78	---	---


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX40MIMO	Ant2	6565	0.07	0.09	77.78	---	---
11AX40MIMO	Ant1	6685	0.07	0.09	77.78	---	---
11AX40MIMO	Ant2	6685	0.07	0.09	77.78	---	---
11AX40MIMO	Ant1	6845	0.06	0.08	75.00	---	---
11AX40MIMO	Ant2	6845	0.06	0.08	75.00	---	---
11AX40MIMO	Ant1	6925	0.06	0.08	75.00	---	---
11AX40MIMO	Ant2	6925	0.07	0.09	77.78	---	---
11AX40MIMO	Ant1	6965	0.07	0.09	77.78	---	---
11AX40MIMO	Ant2	6965	0.06	0.08	75.00	---	---
11AX40MIMO	Ant1	7085	0.07	0.09	77.78	---	---
11AX40MIMO	Ant2	7085	0.07	0.09	77.78	---	---
11AX80MIMO	Ant1	5985	0.04	0.06	66.67	---	---
11AX80MIMO	Ant2	5985	0.04	0.06	66.67	---	---
11AX80MIMO	Ant1	6145	0.03	0.05	60.00	---	---
11AX80MIMO	Ant2	6145	0.04	0.06	66.67	---	---
11AX80MIMO	Ant1	6385	0.04	0.06	66.67	---	---
11AX80MIMO	Ant2	6385	0.04	0.06	66.67	---	---
11AX80MIMO	Ant1	6465	0.04	0.06	66.67	---	---
11AX80MIMO	Ant2	6465	0.03	0.05	60.00	---	---
11AX80MIMO	Ant1	6545	0.04	0.06	66.67	---	---
11AX80MIMO	Ant2	6545	0.04	0.06	66.67	---	---
11AX80MIMO	Ant1	6625	0.04	0.06	66.67	---	---
11AX80MIMO	Ant2	6625	0.04	0.06	66.67	---	---
11AX80MIMO	Ant1	6705	0.04	0.06	66.67	---	---
11AX80MIMO	Ant2	6705	0.04	0.06	66.67	---	---
11AX80MIMO	Ant1	6785	0.04	0.06	66.67	---	---
11AX80MIMO	Ant2	6785	0.04	0.06	66.67	---	---
11AX80MIMO	Ant1	6865	0.04	0.06	66.67	---	---
11AX80MIMO	Ant2	6865	0.04	0.06	66.67	---	---
11AX80MIMO	Ant1	6945	0.04	0.06	66.67	---	---
11AX80MIMO	Ant2	6945	0.04	0.06	66.67	---	---
11AX80MIMO	Ant1	7025	0.04	0.06	66.67	---	---
11AX80MIMO	Ant2	7025	0.03	0.05	60.00	---	---


Test Graphs

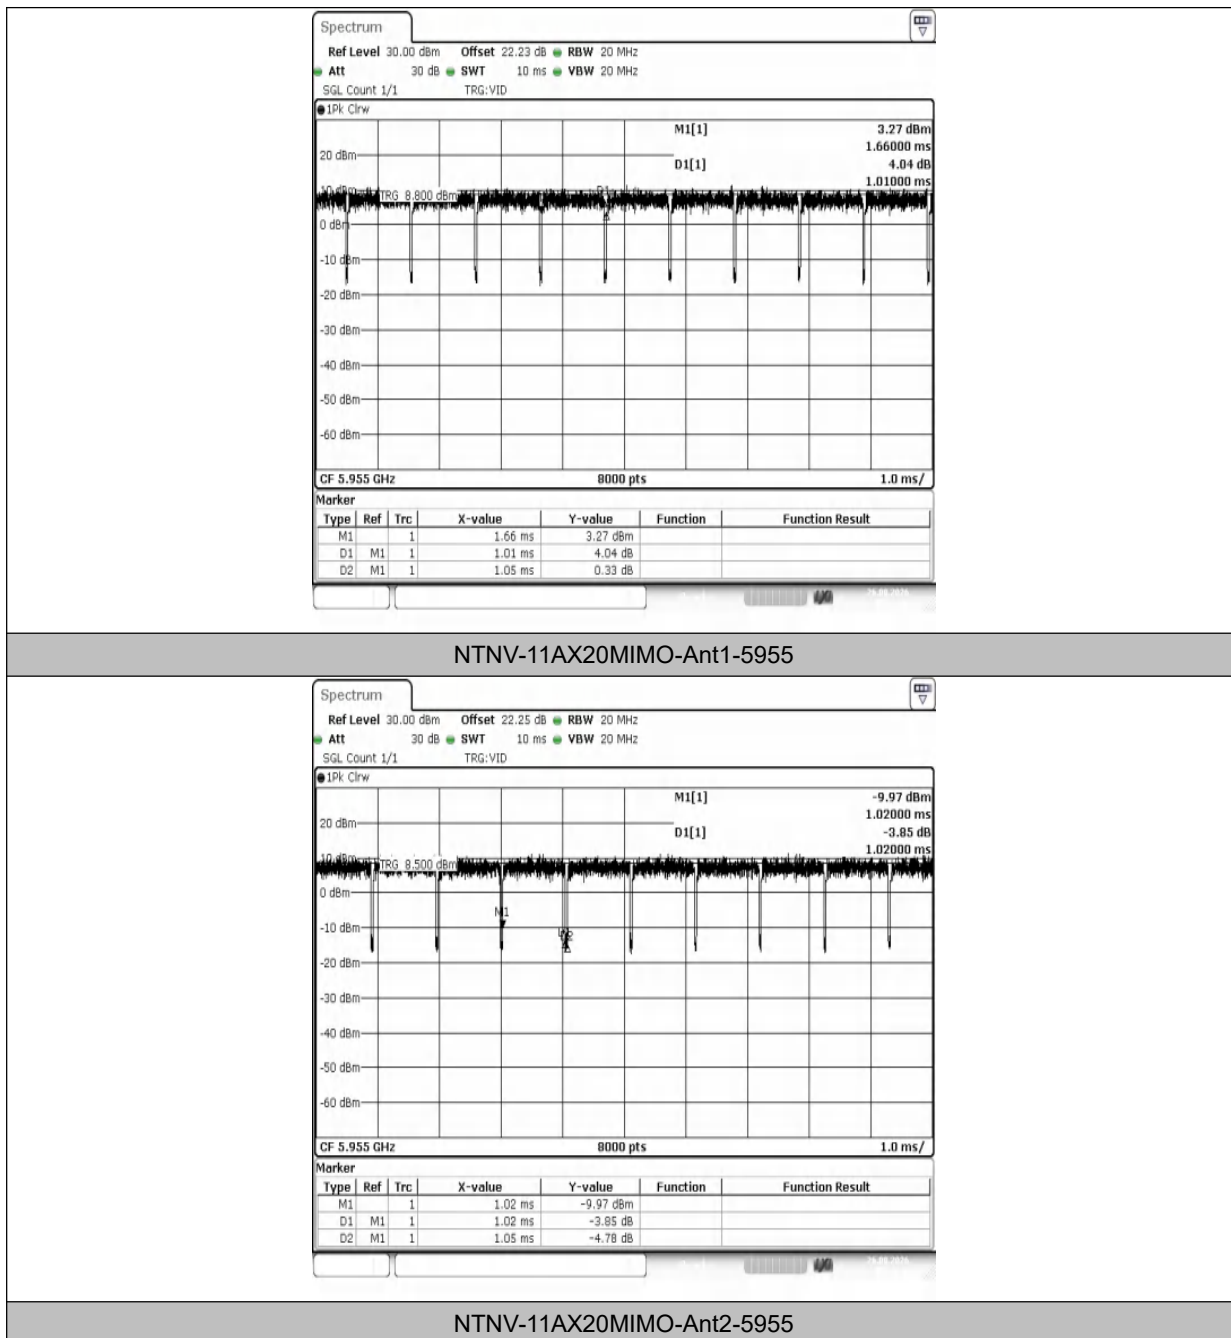


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

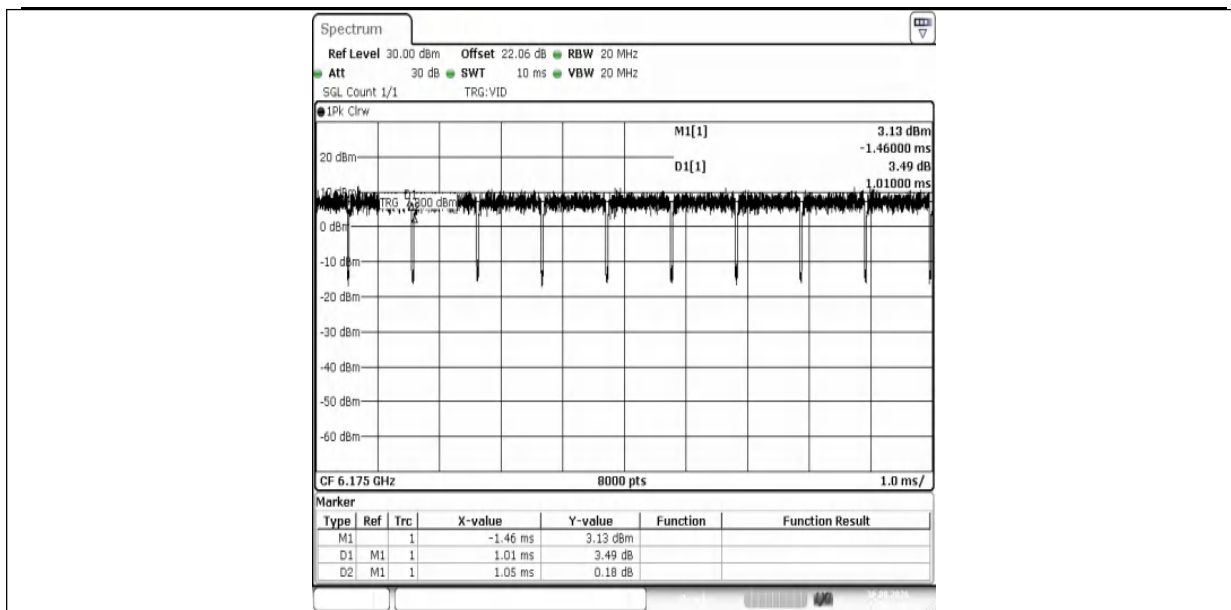

NTNV-11AX20MIMO-Ant1-6175

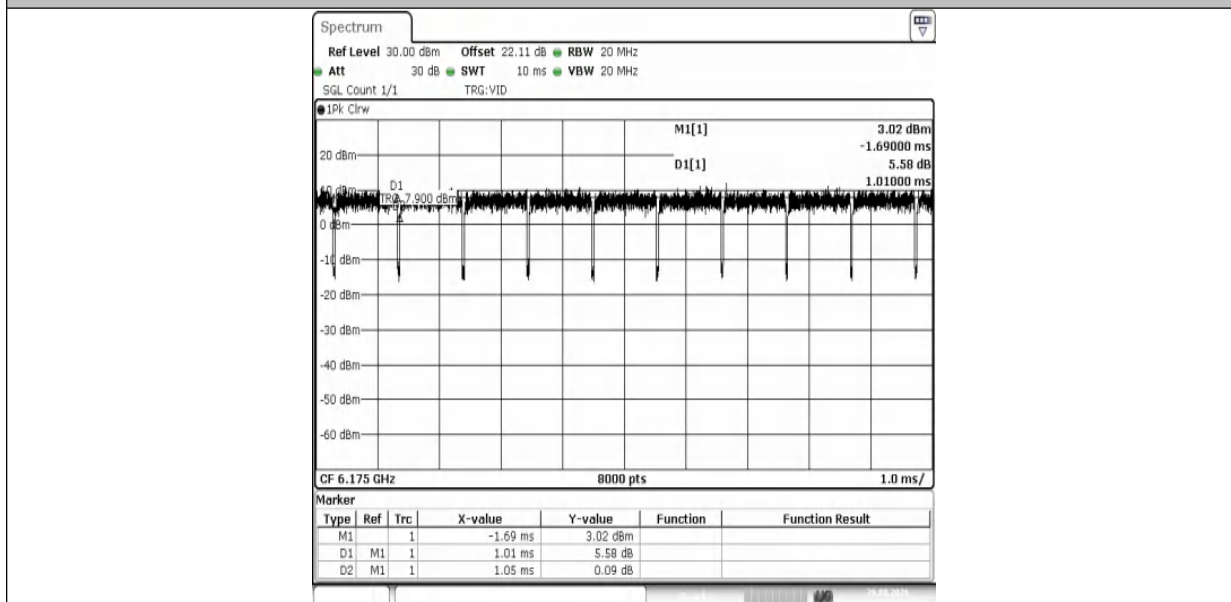


NTNV-11AX20MIMO-Ant2-6175

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

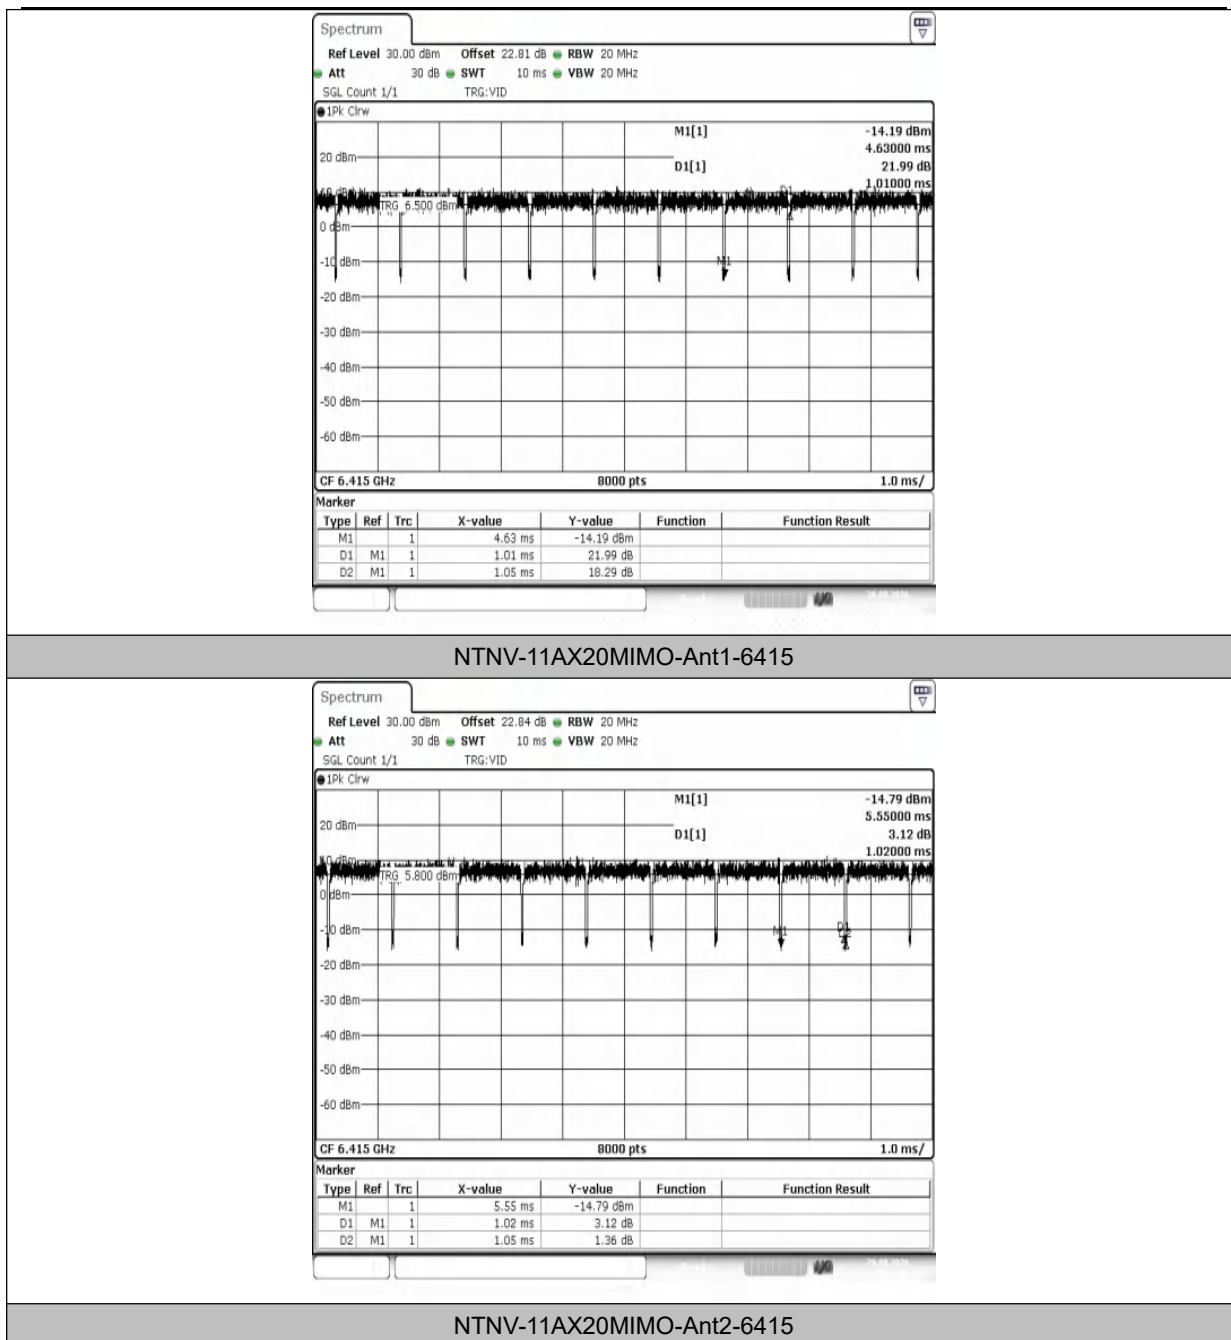

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com