



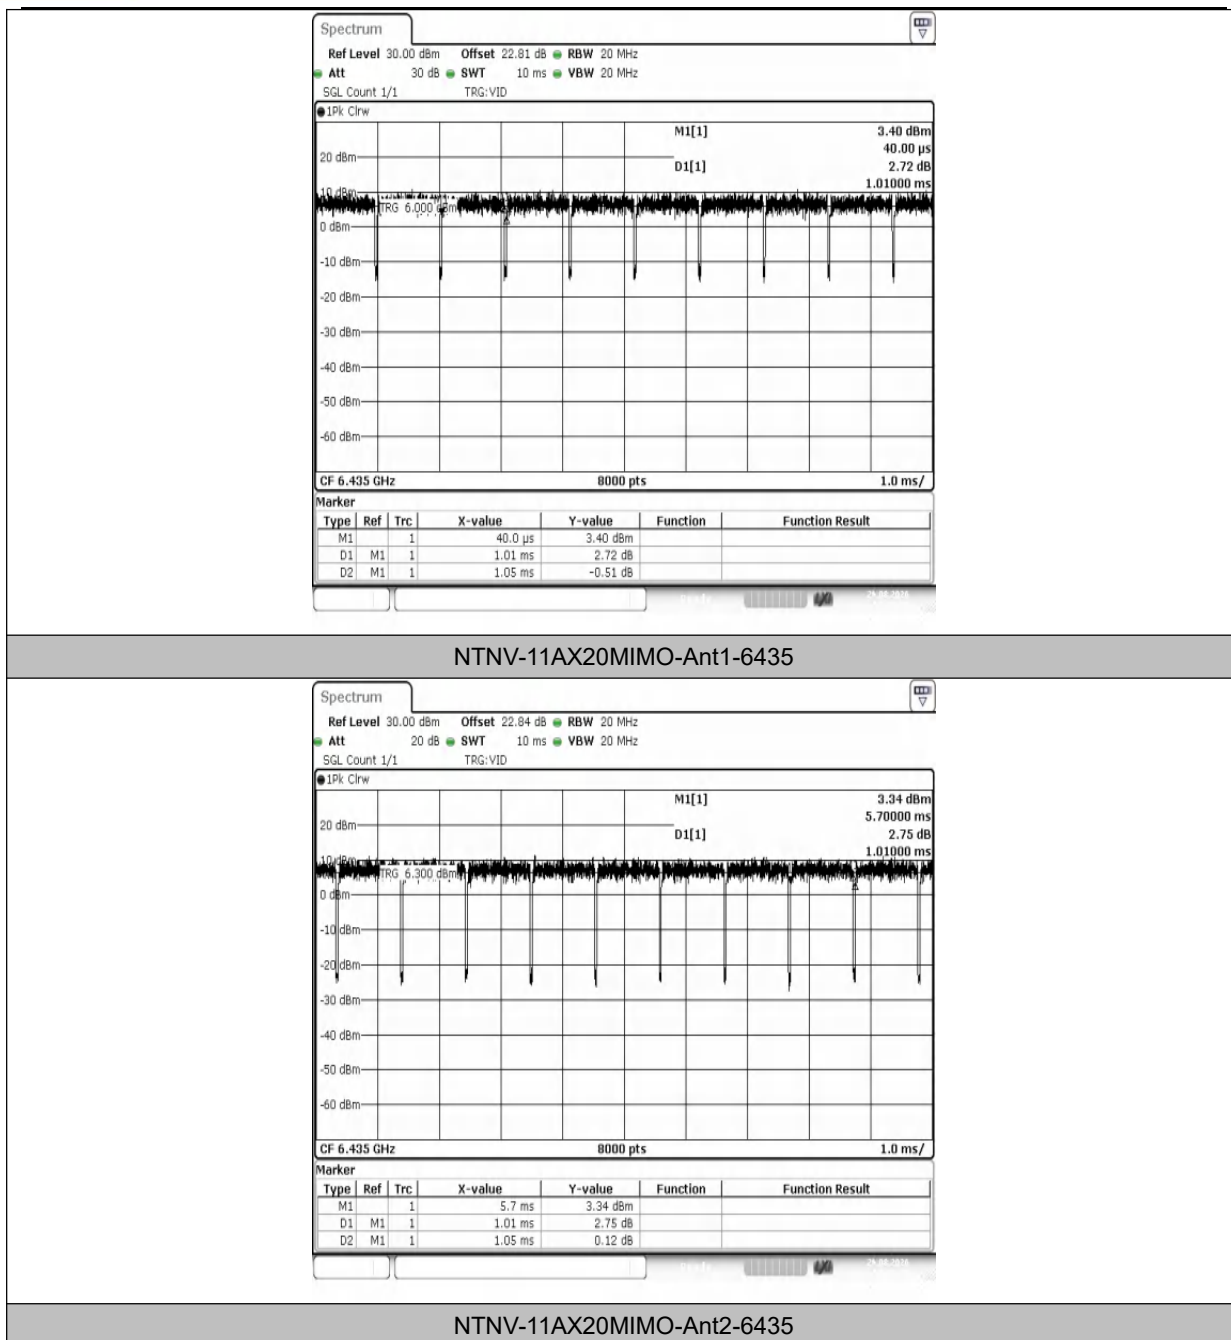

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

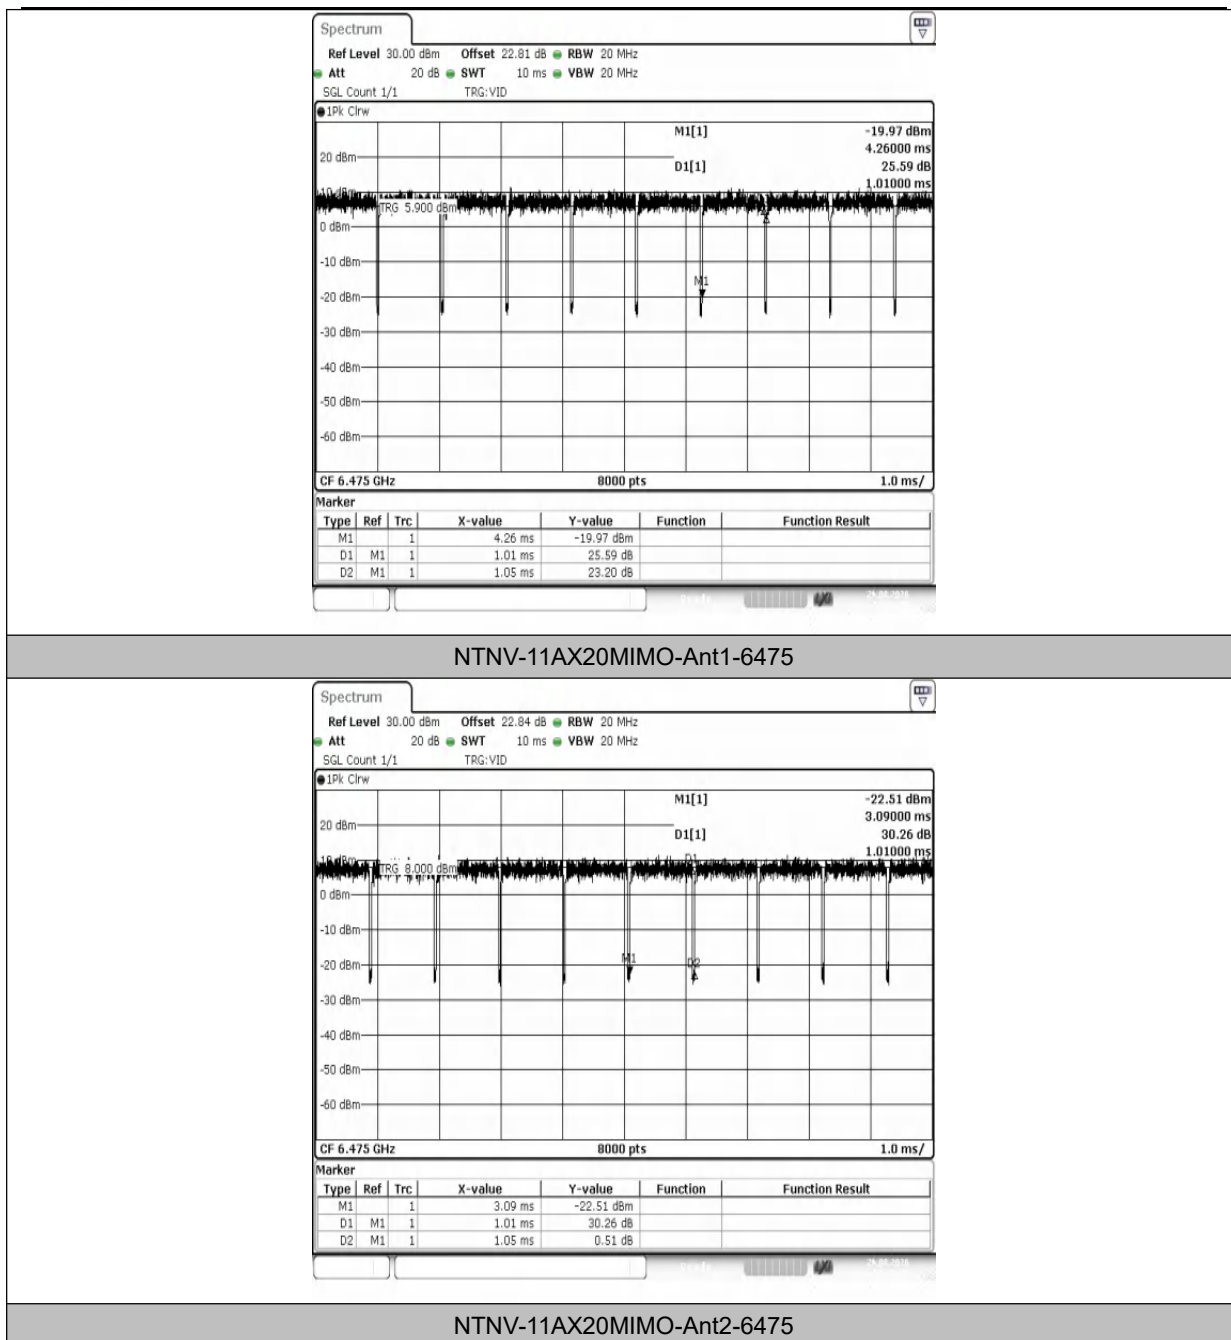

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

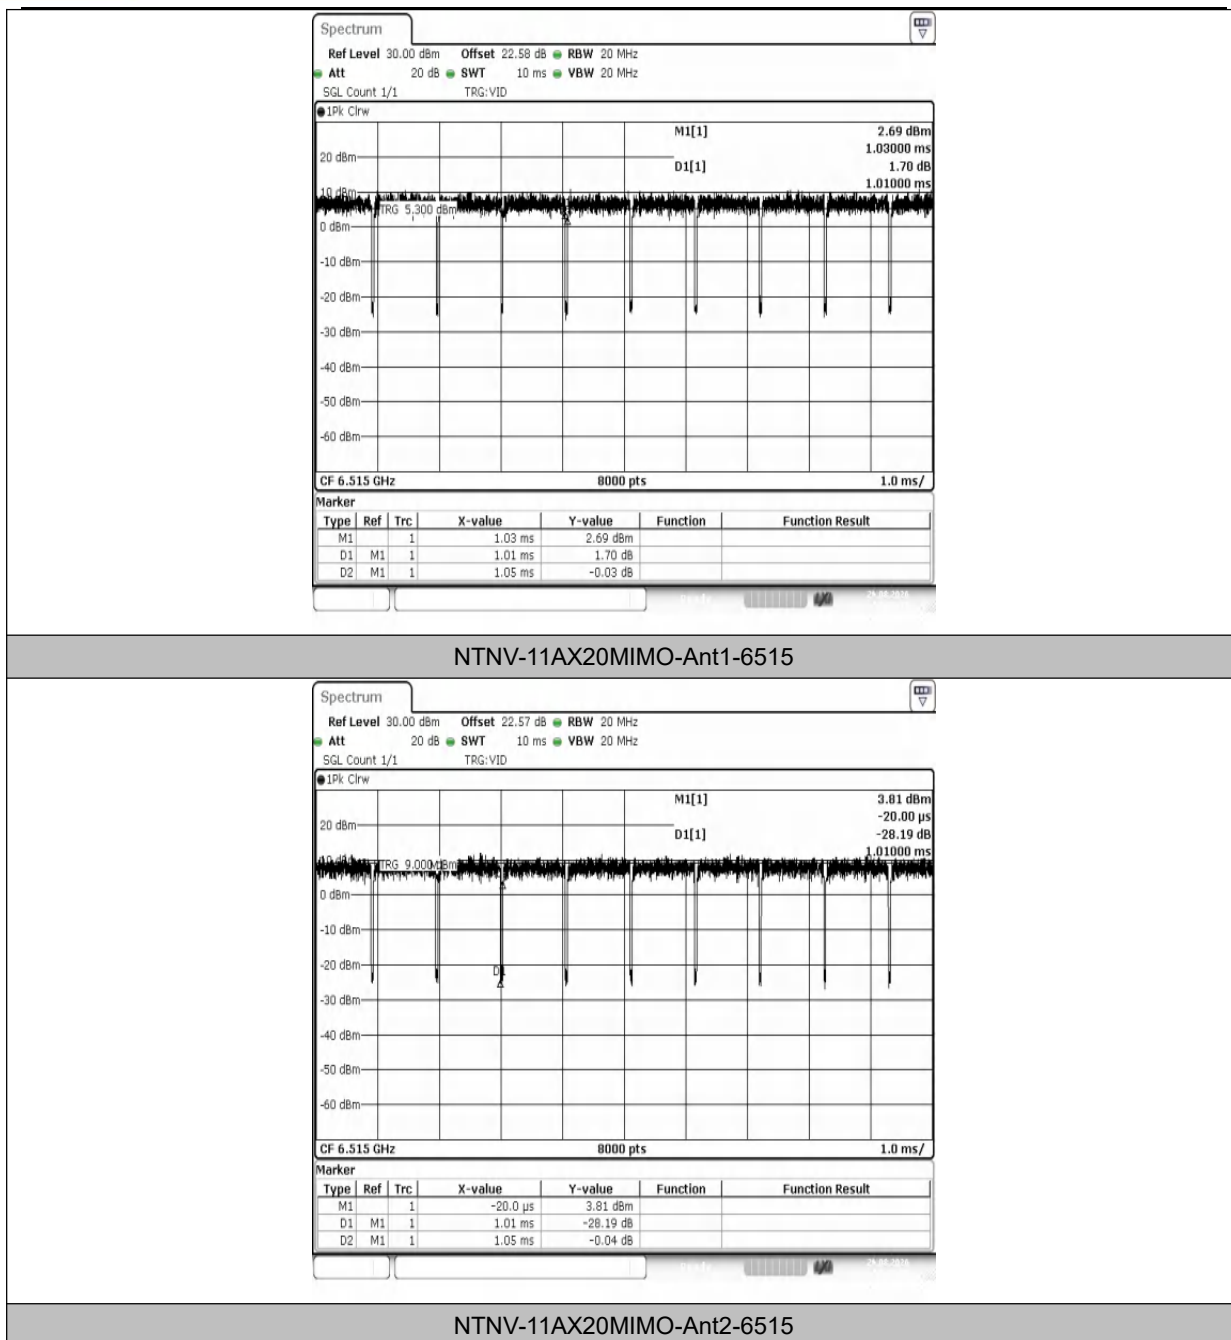

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

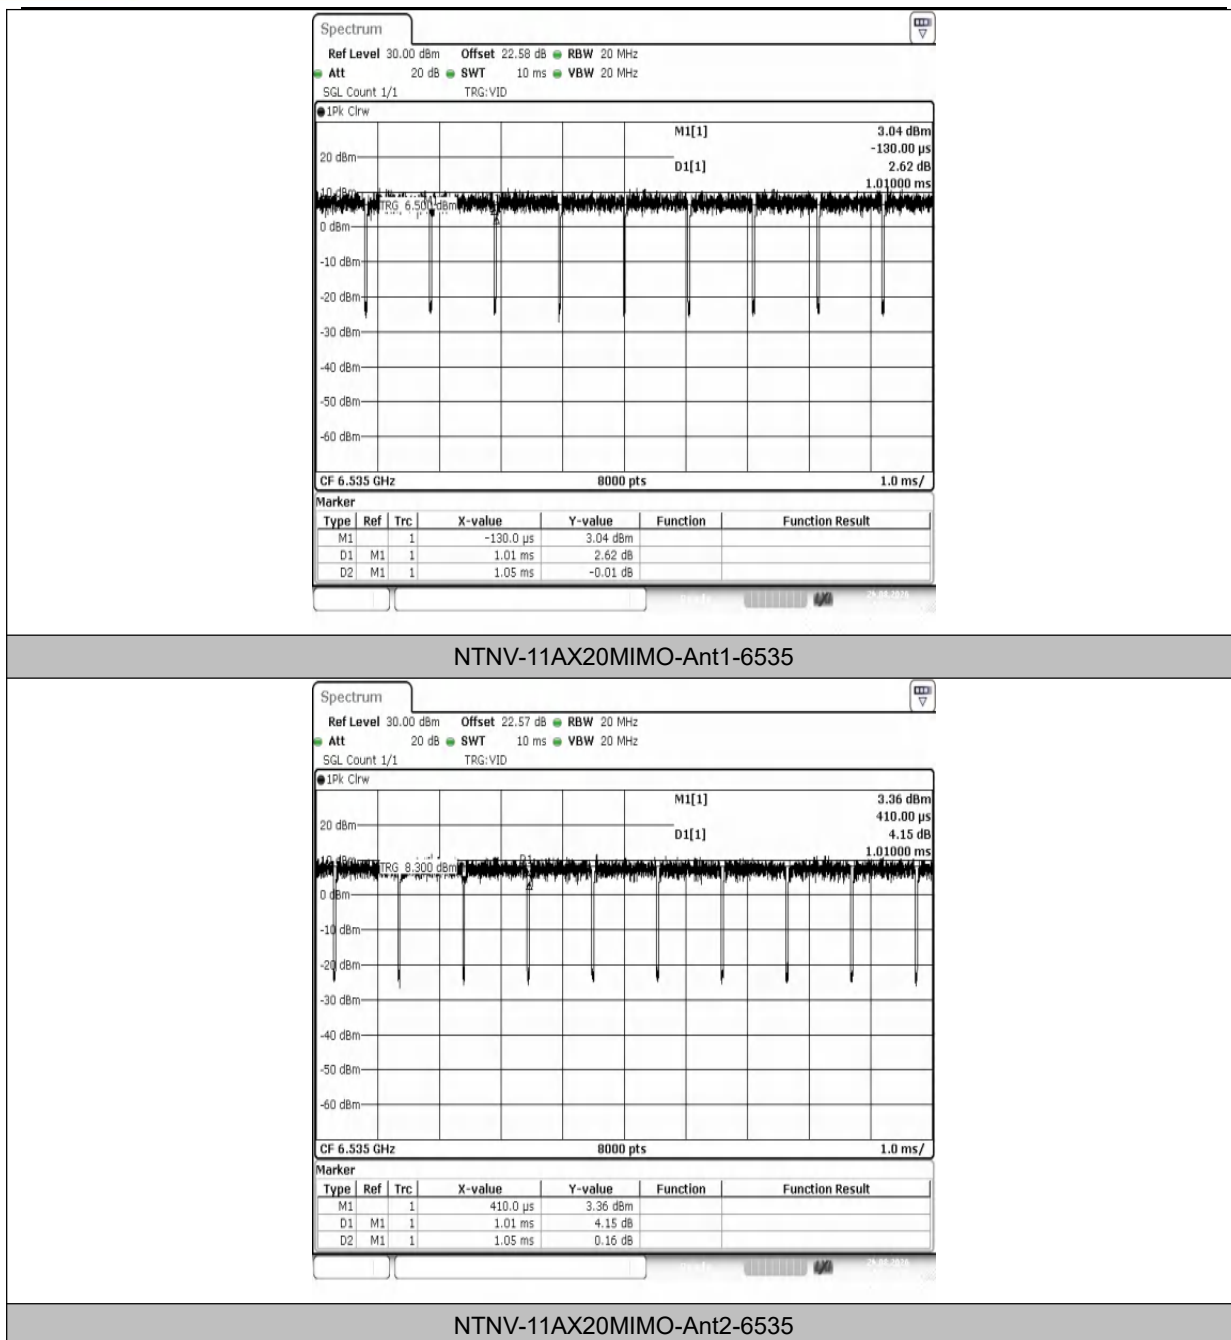

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

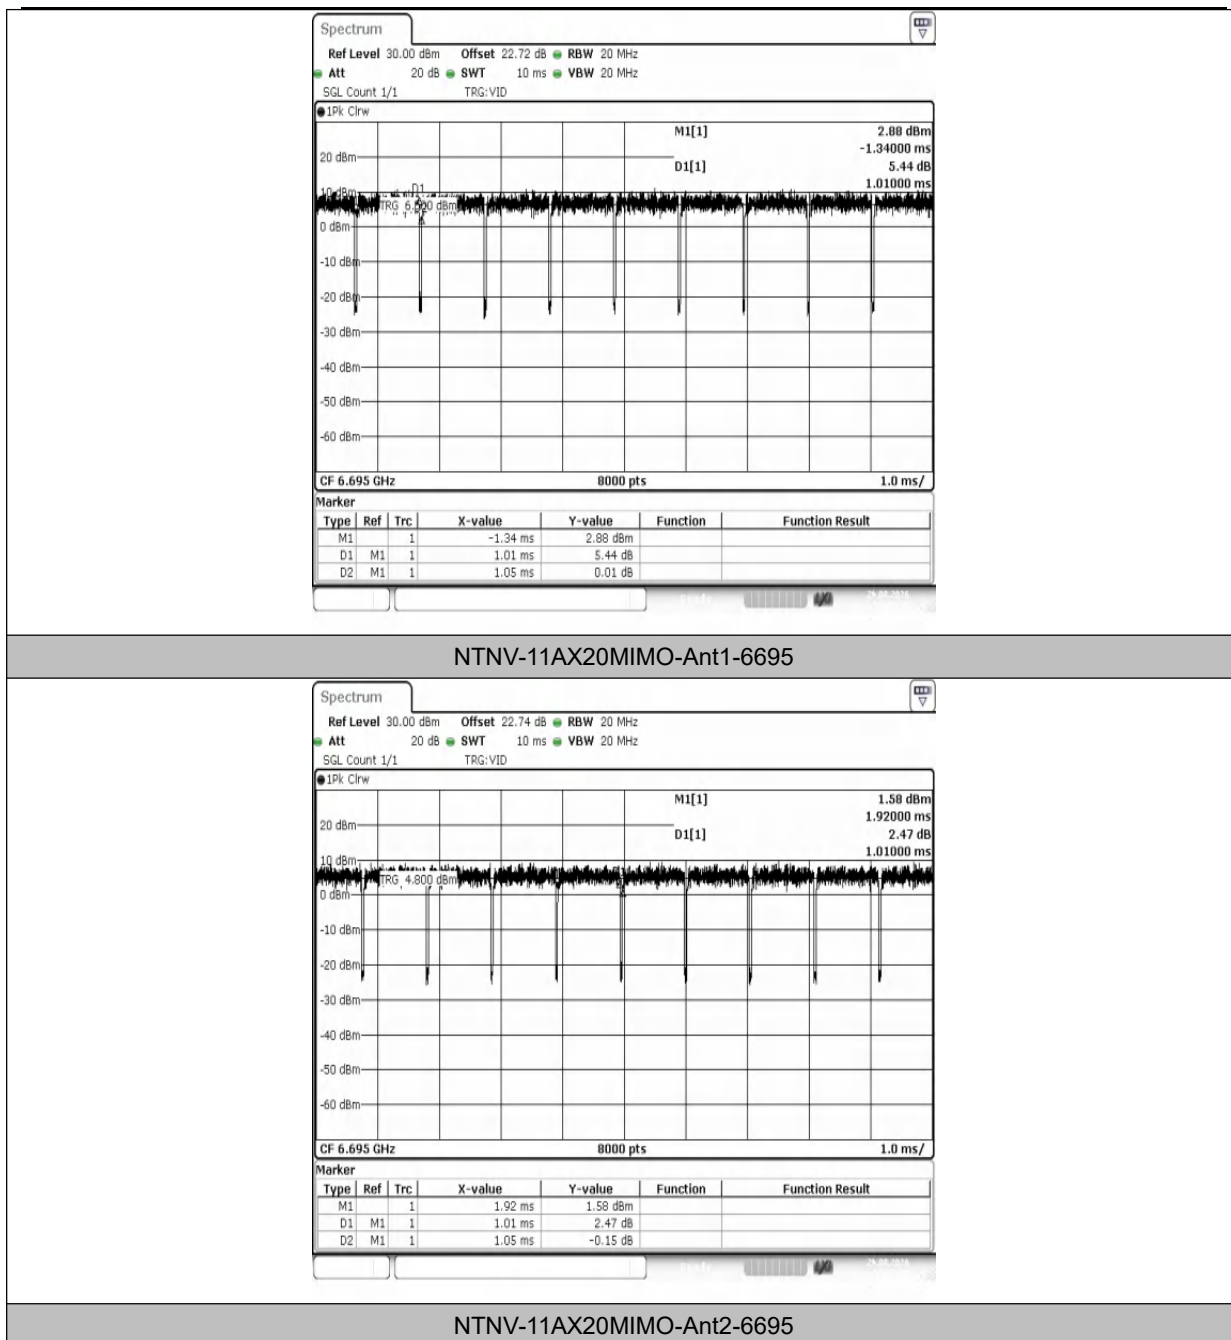

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

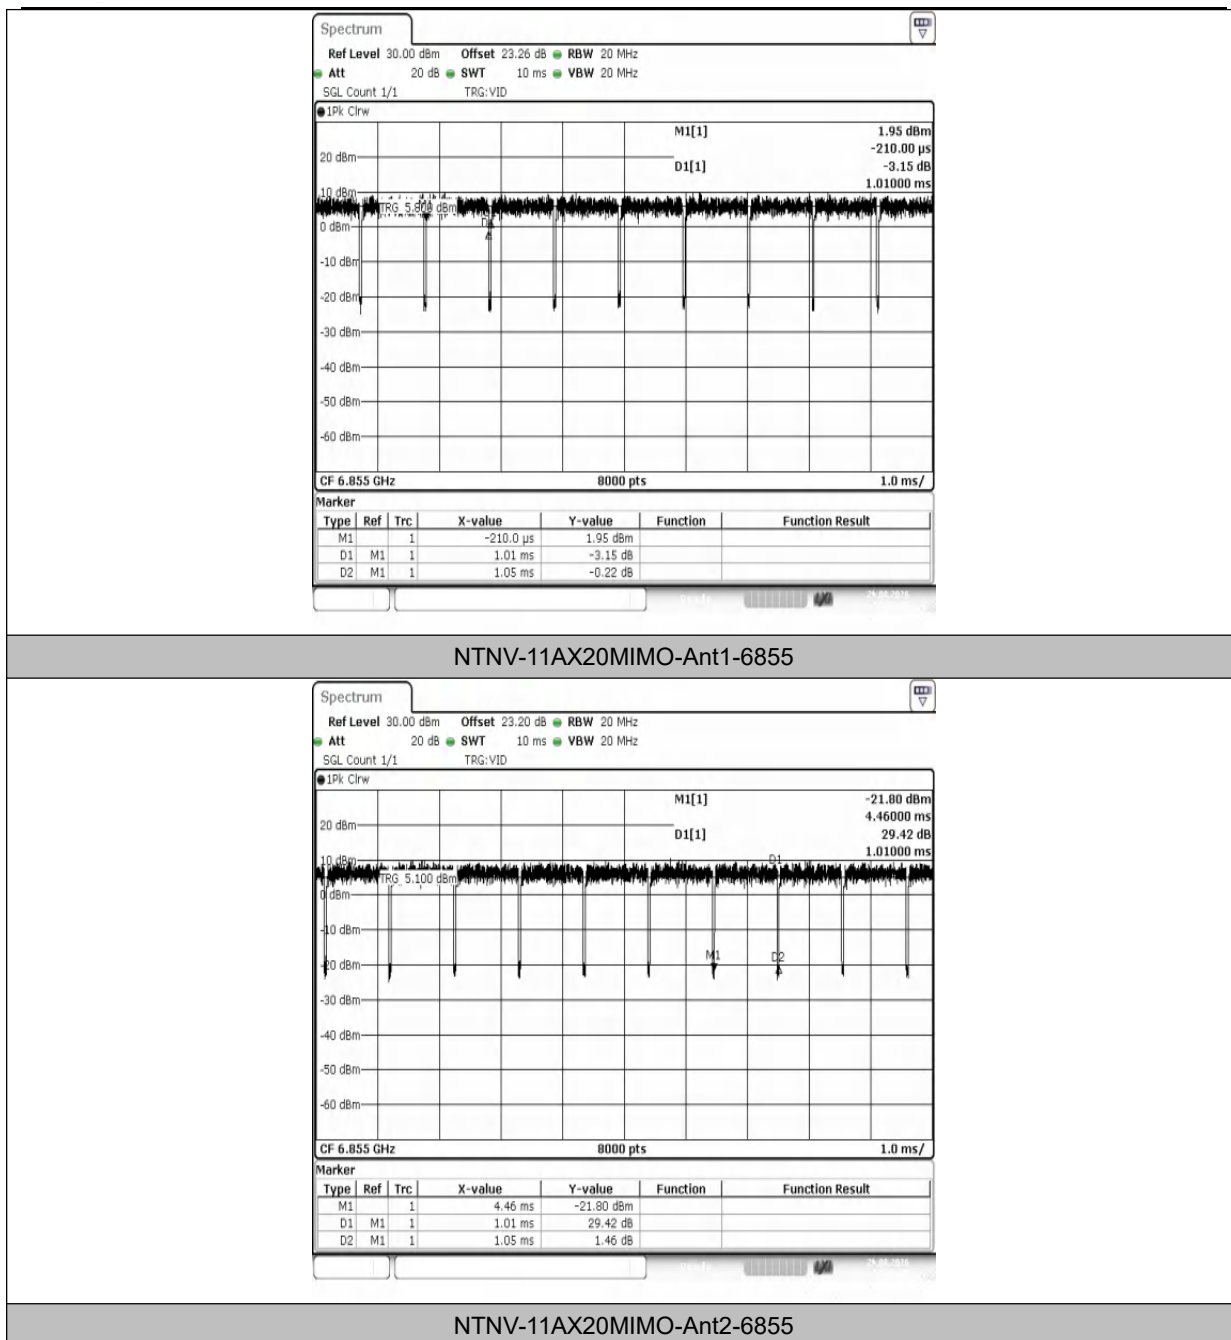

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

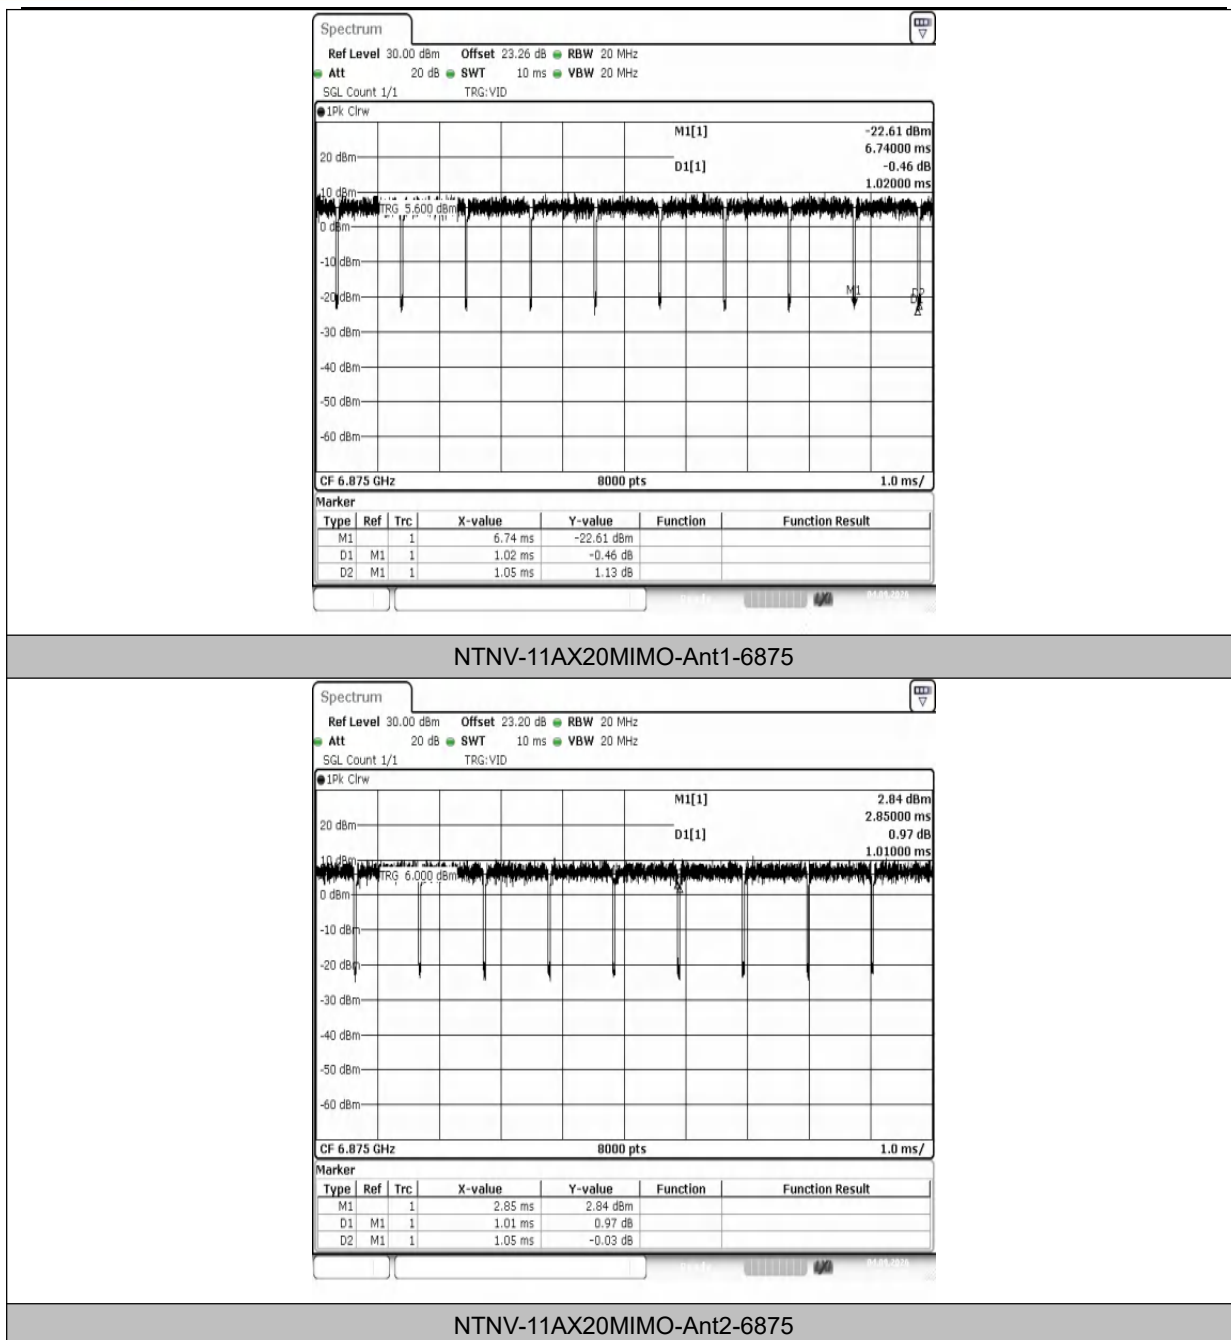


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

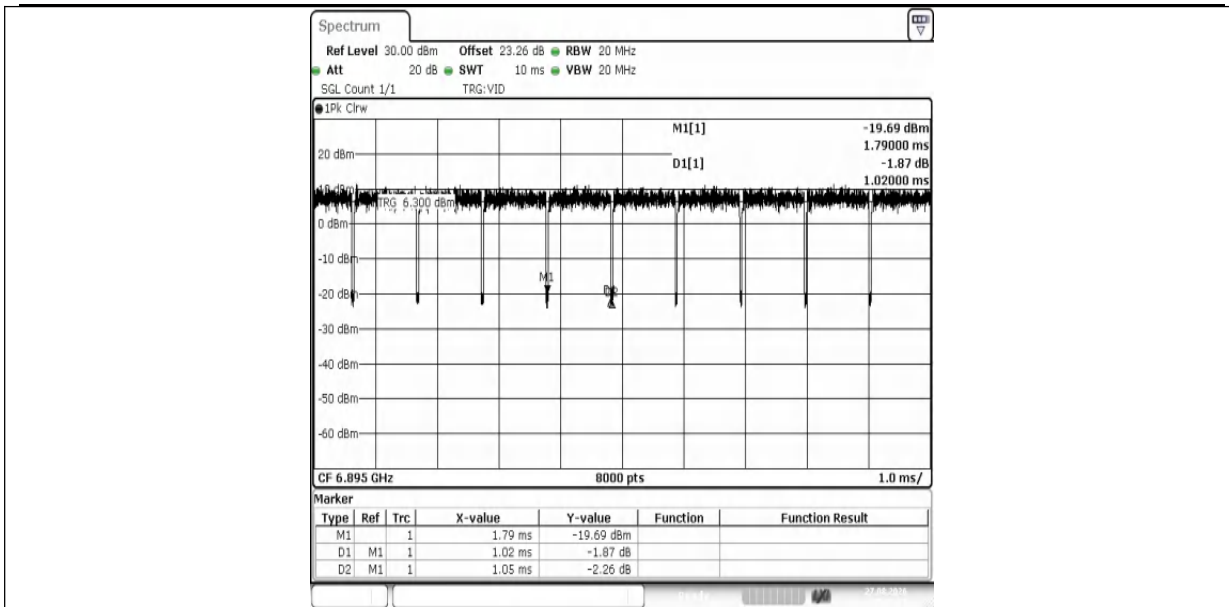

NTNV-11AX20MIMO-Ant1-6895

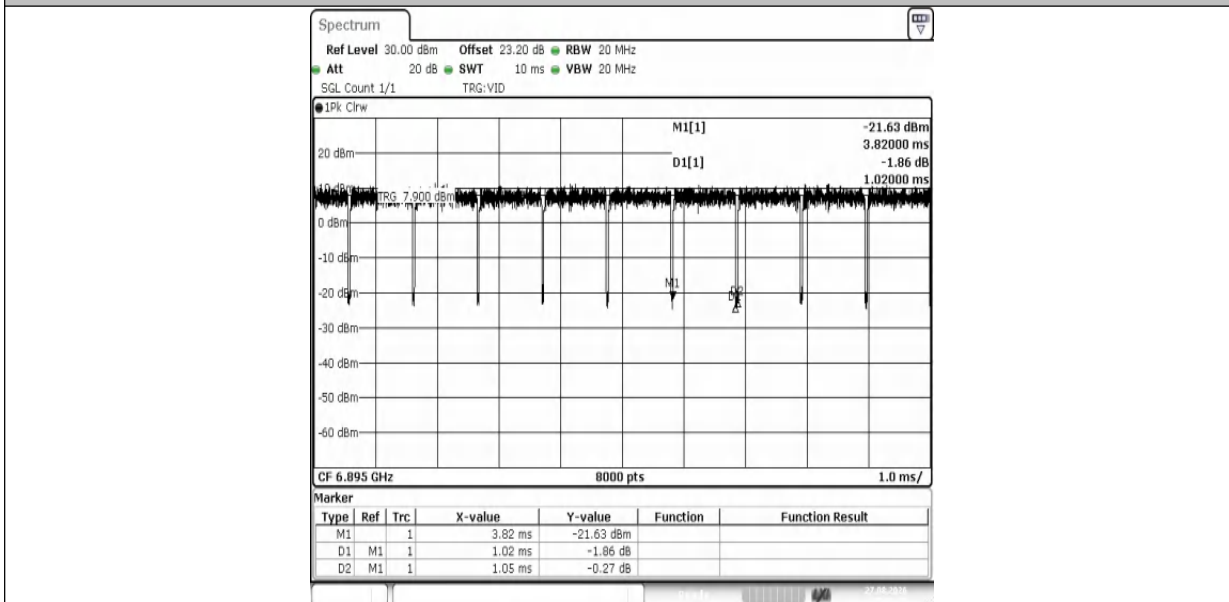


NTNV-11AX20MIMO-Ant2-6895

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

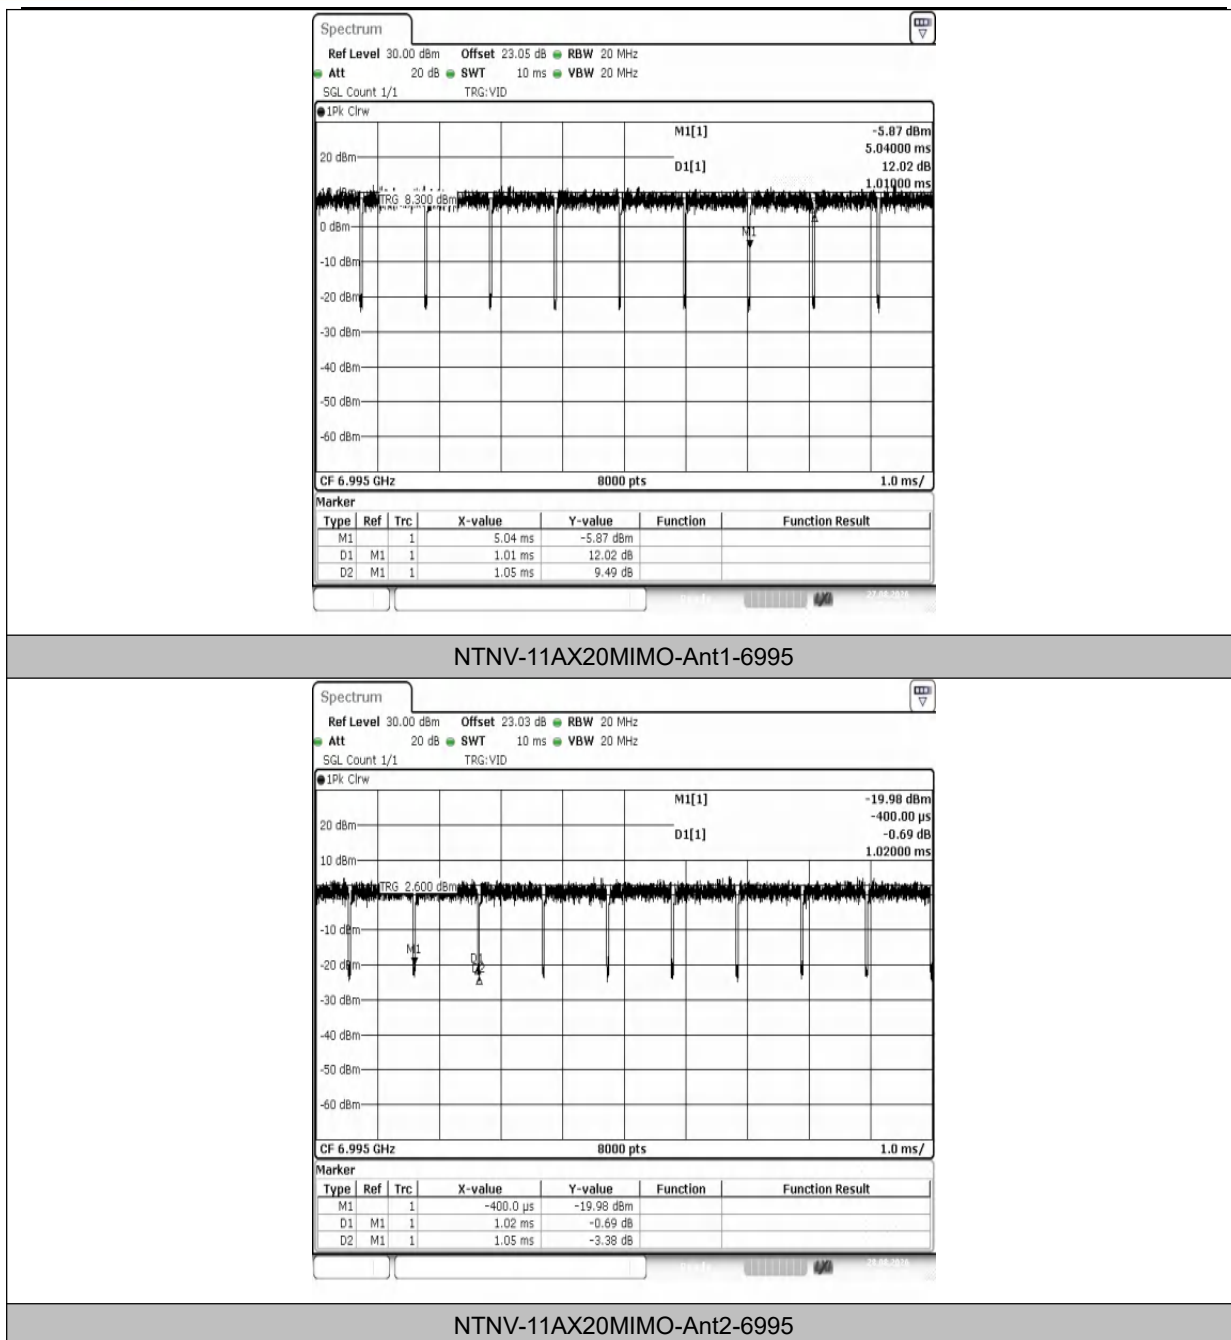


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

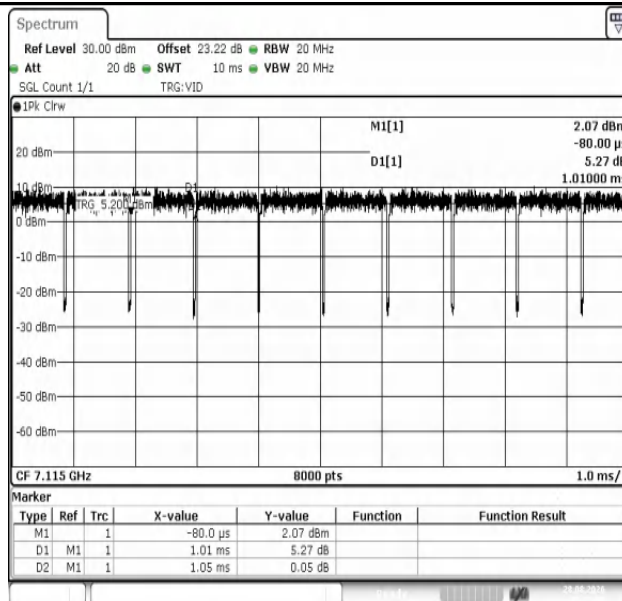

NTNV-11AX20MIMO-Ant1-7115

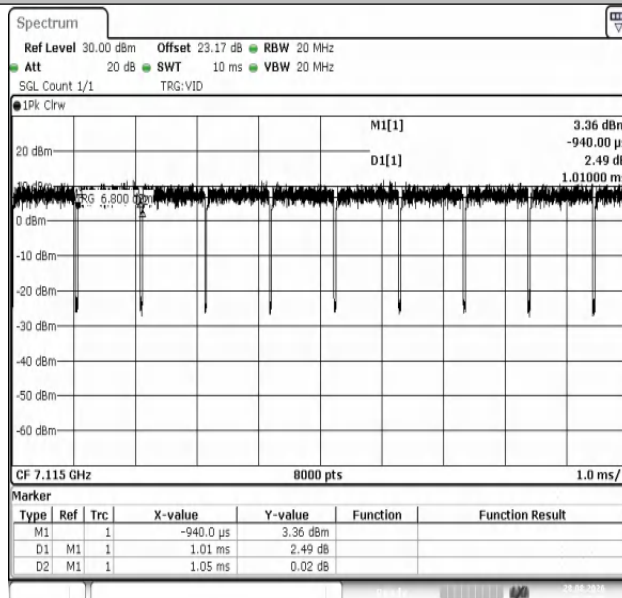


NTNV-11AX20MIMO-Ant2-7115

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

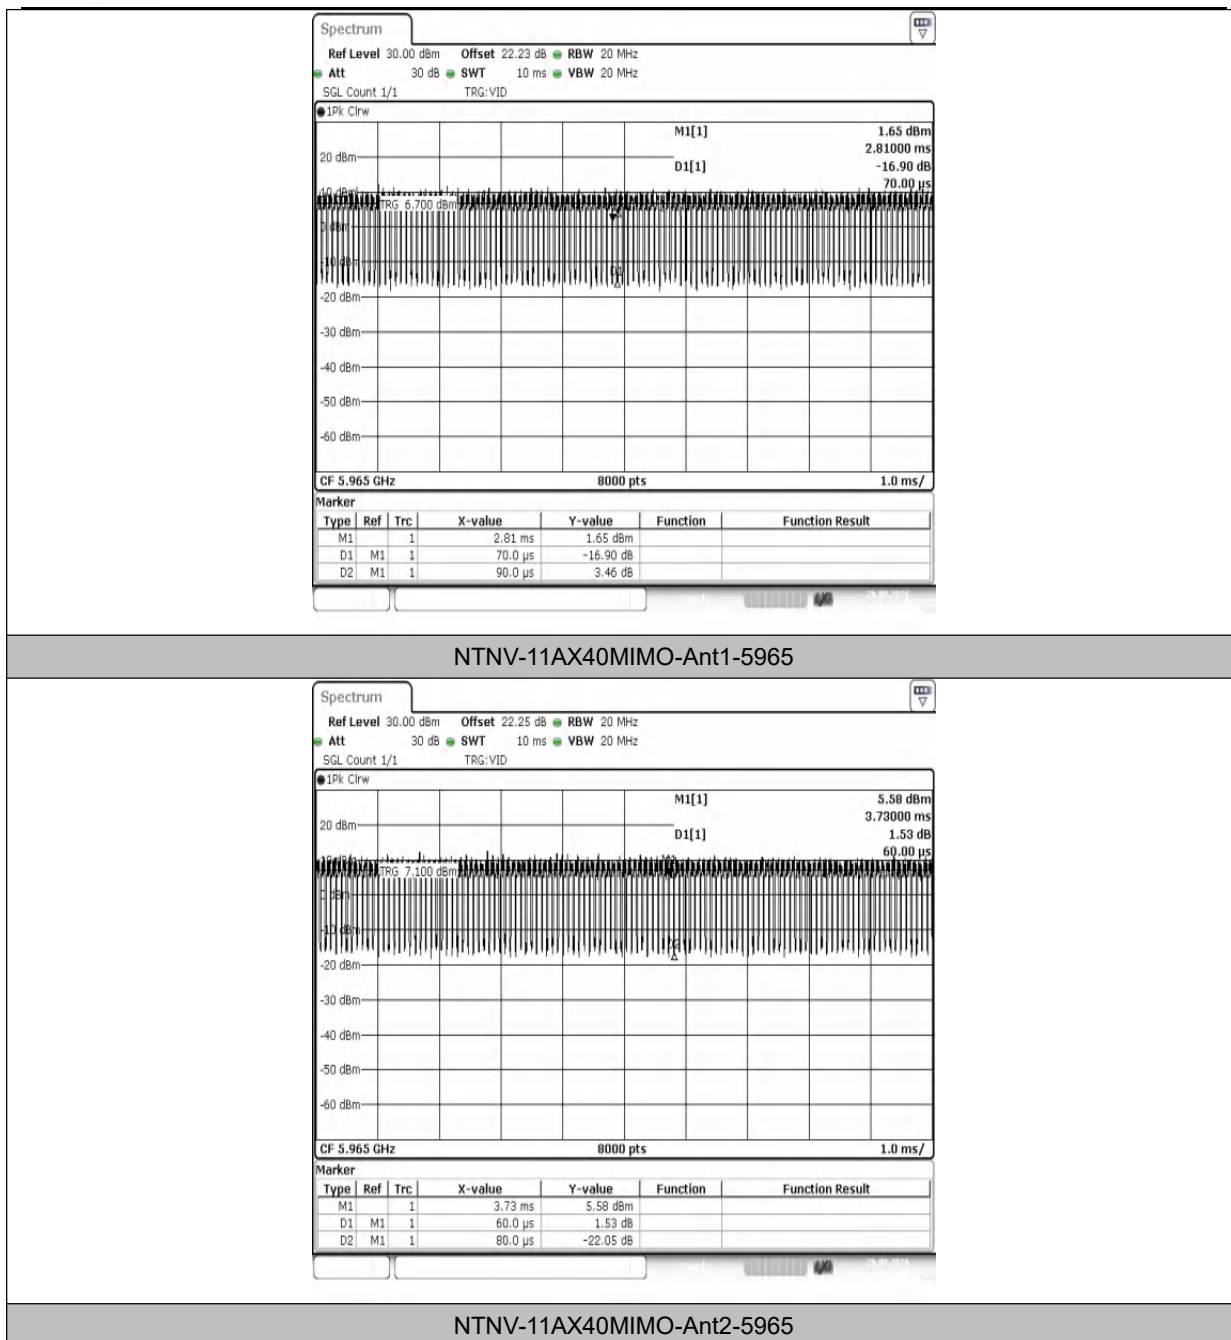

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

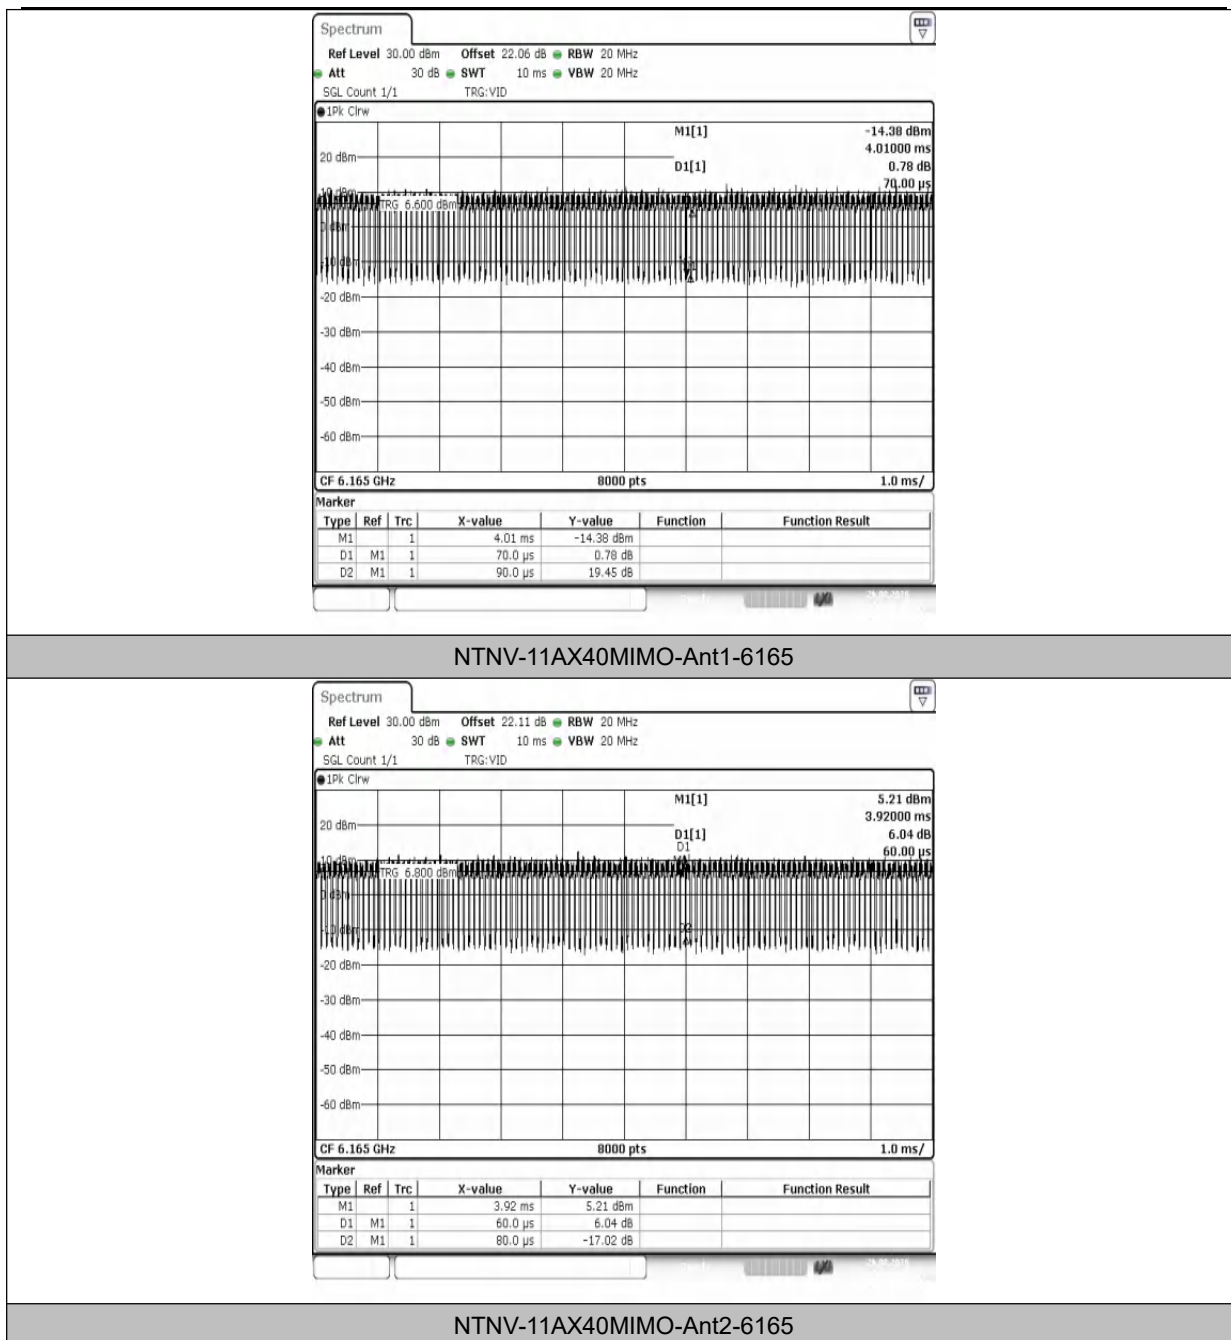

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

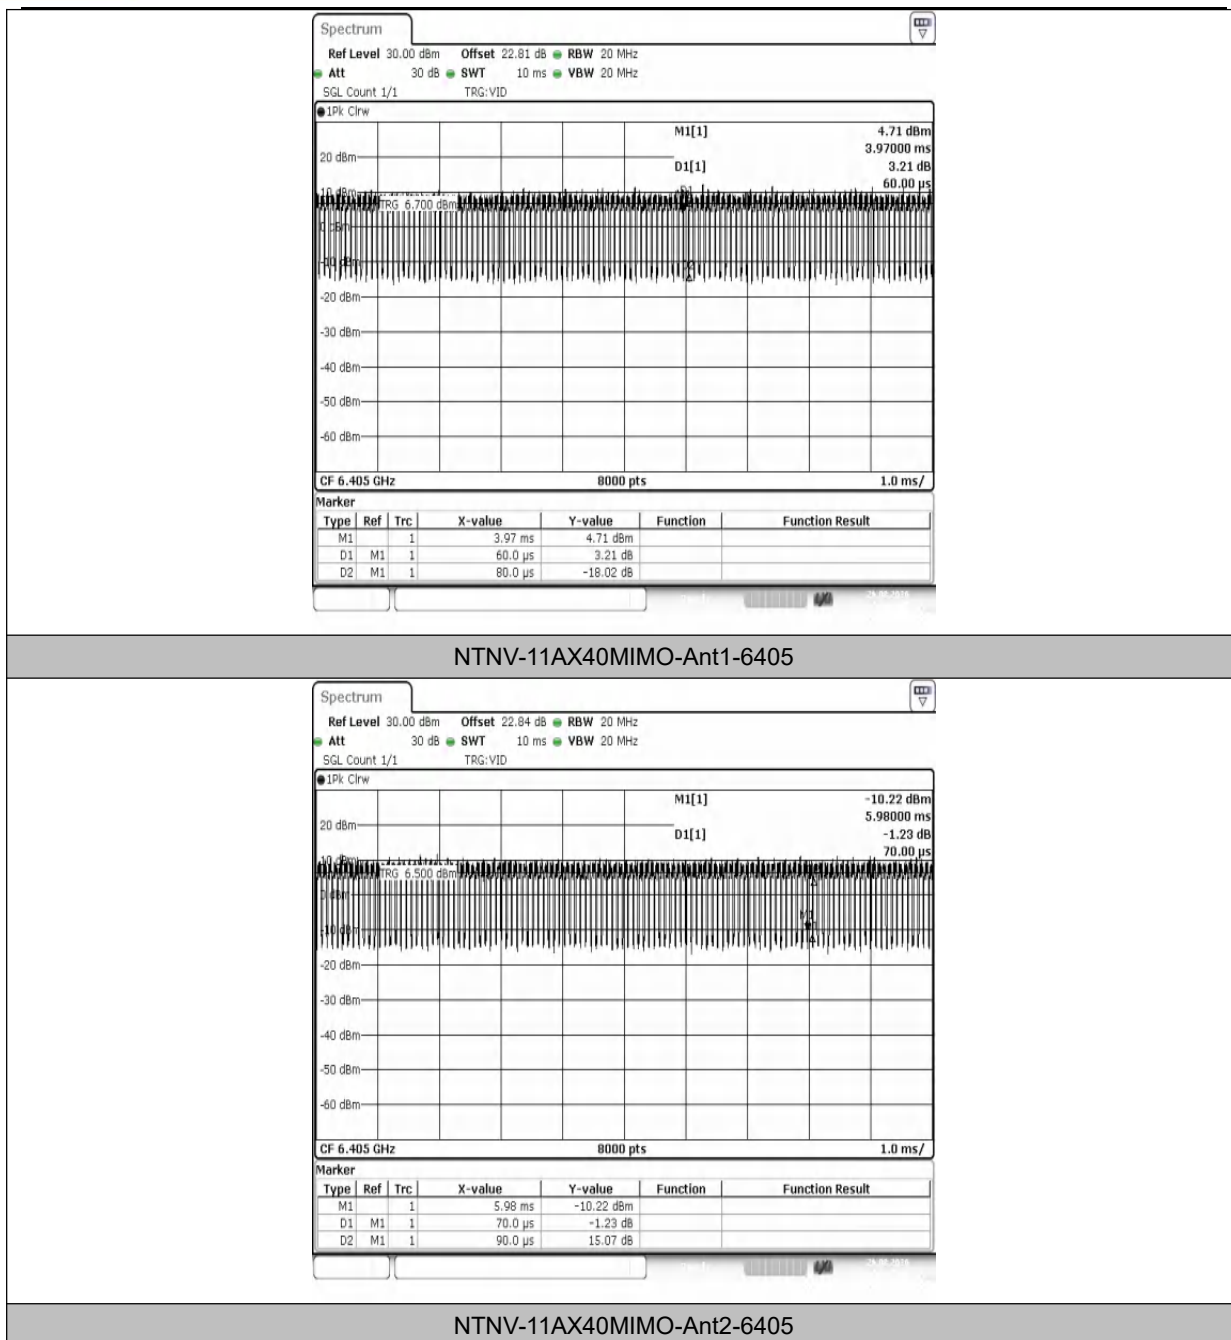

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

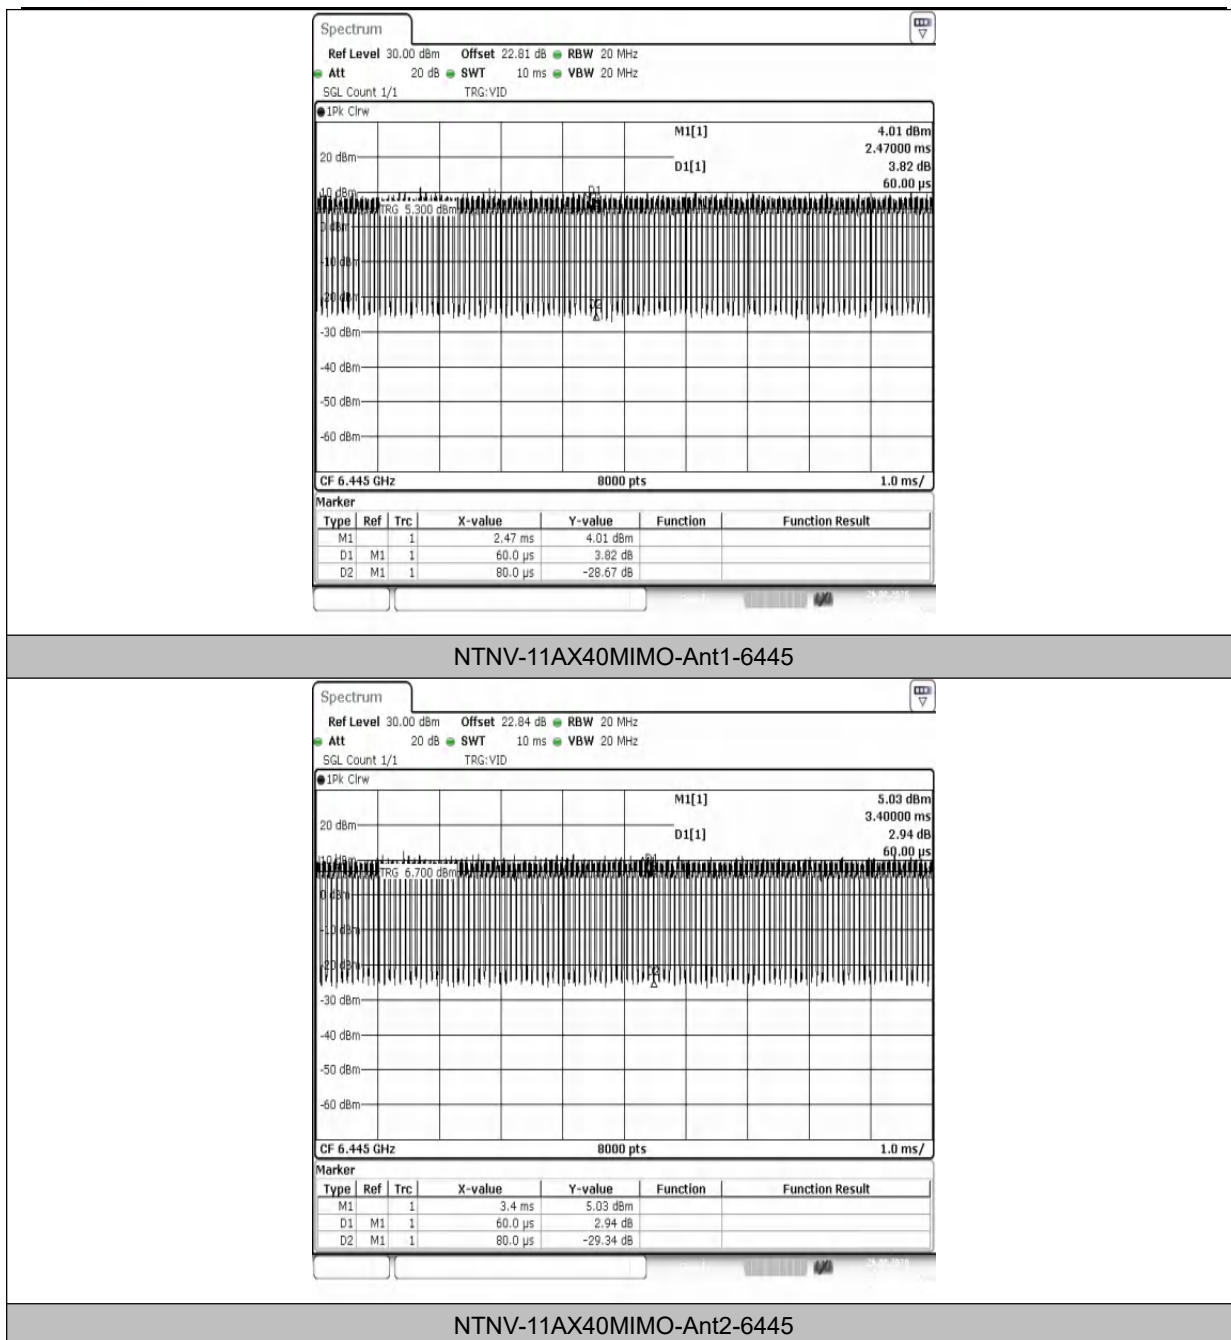

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

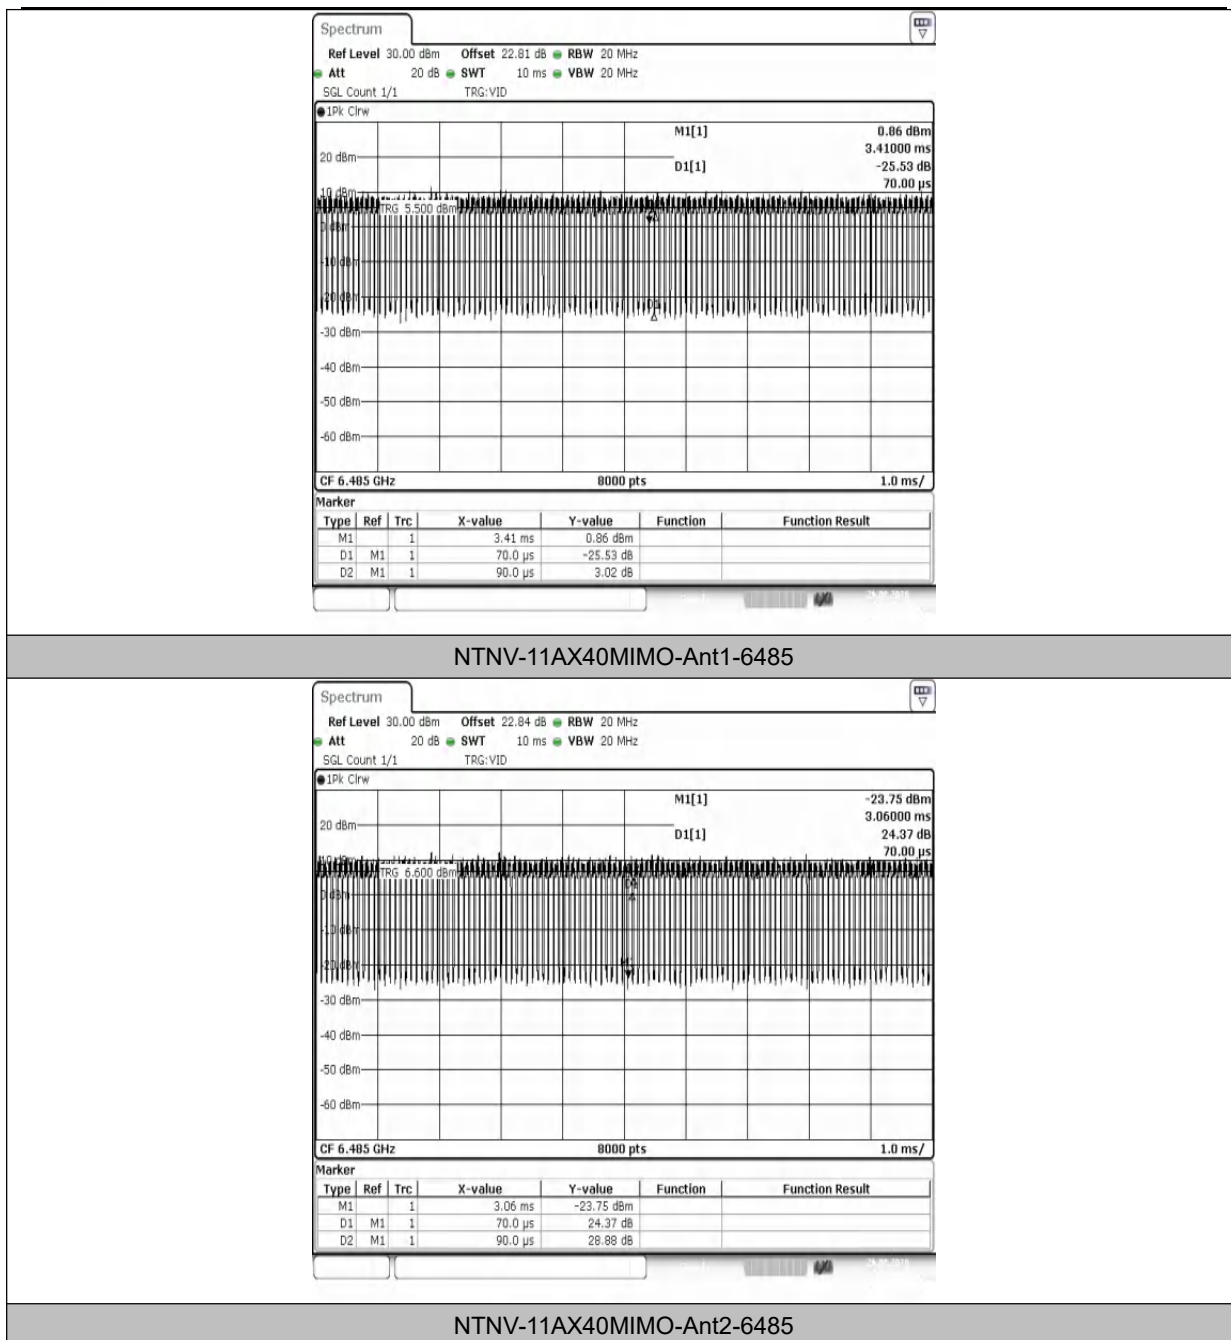

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

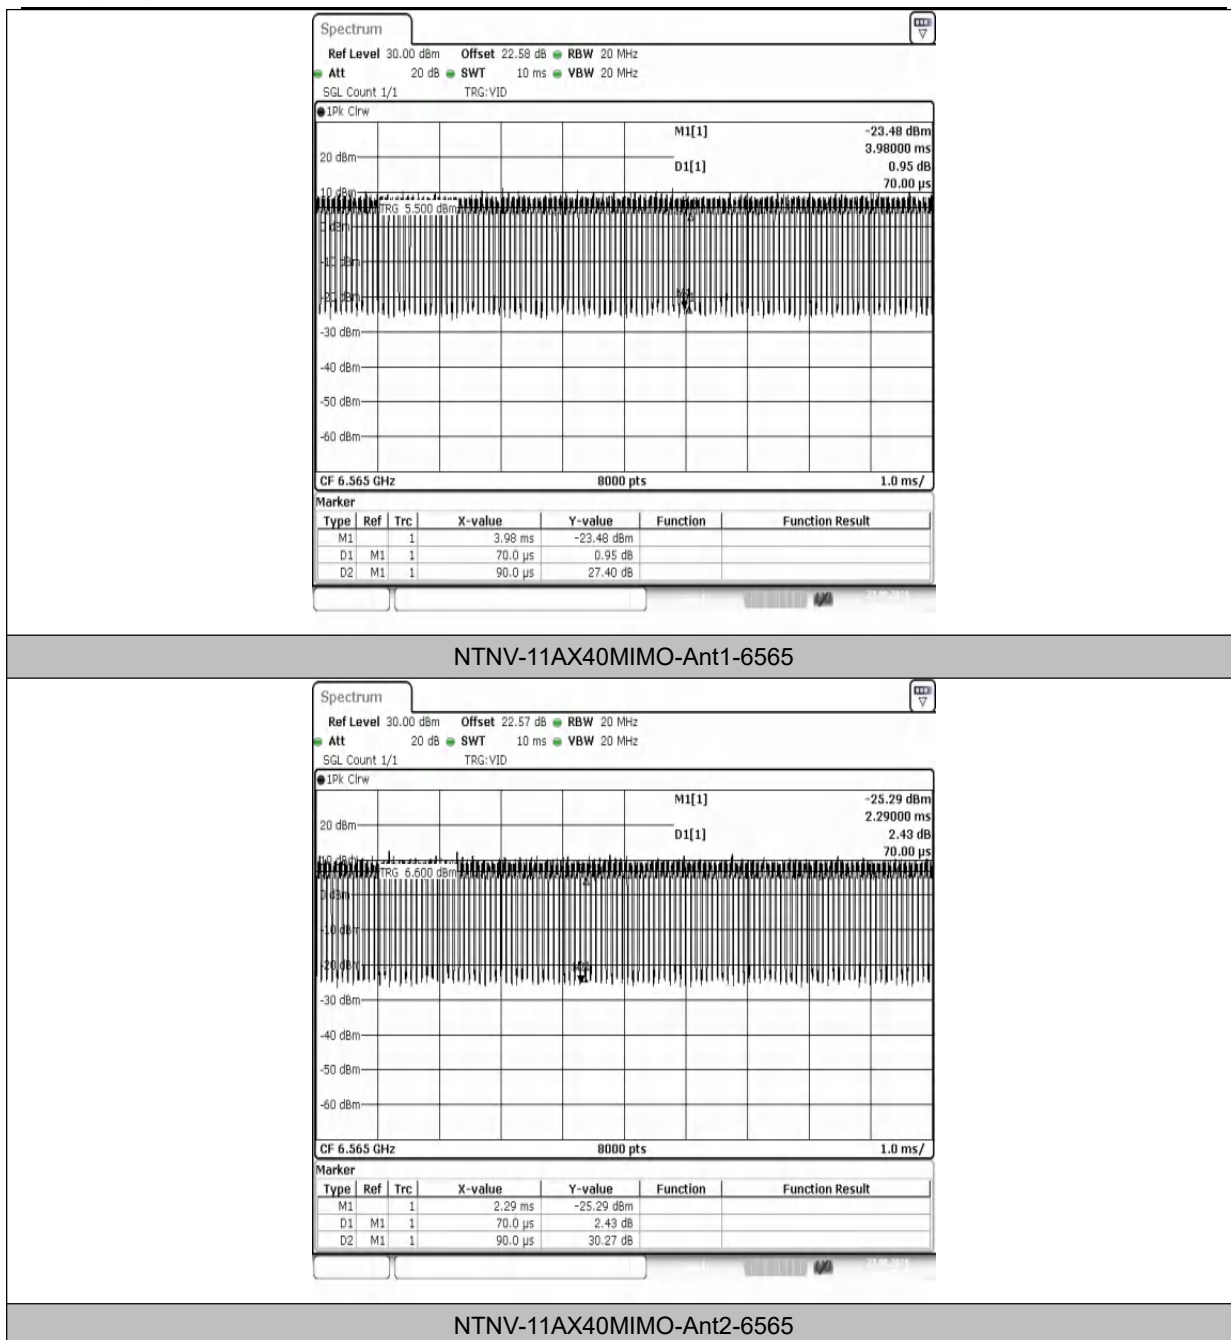

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

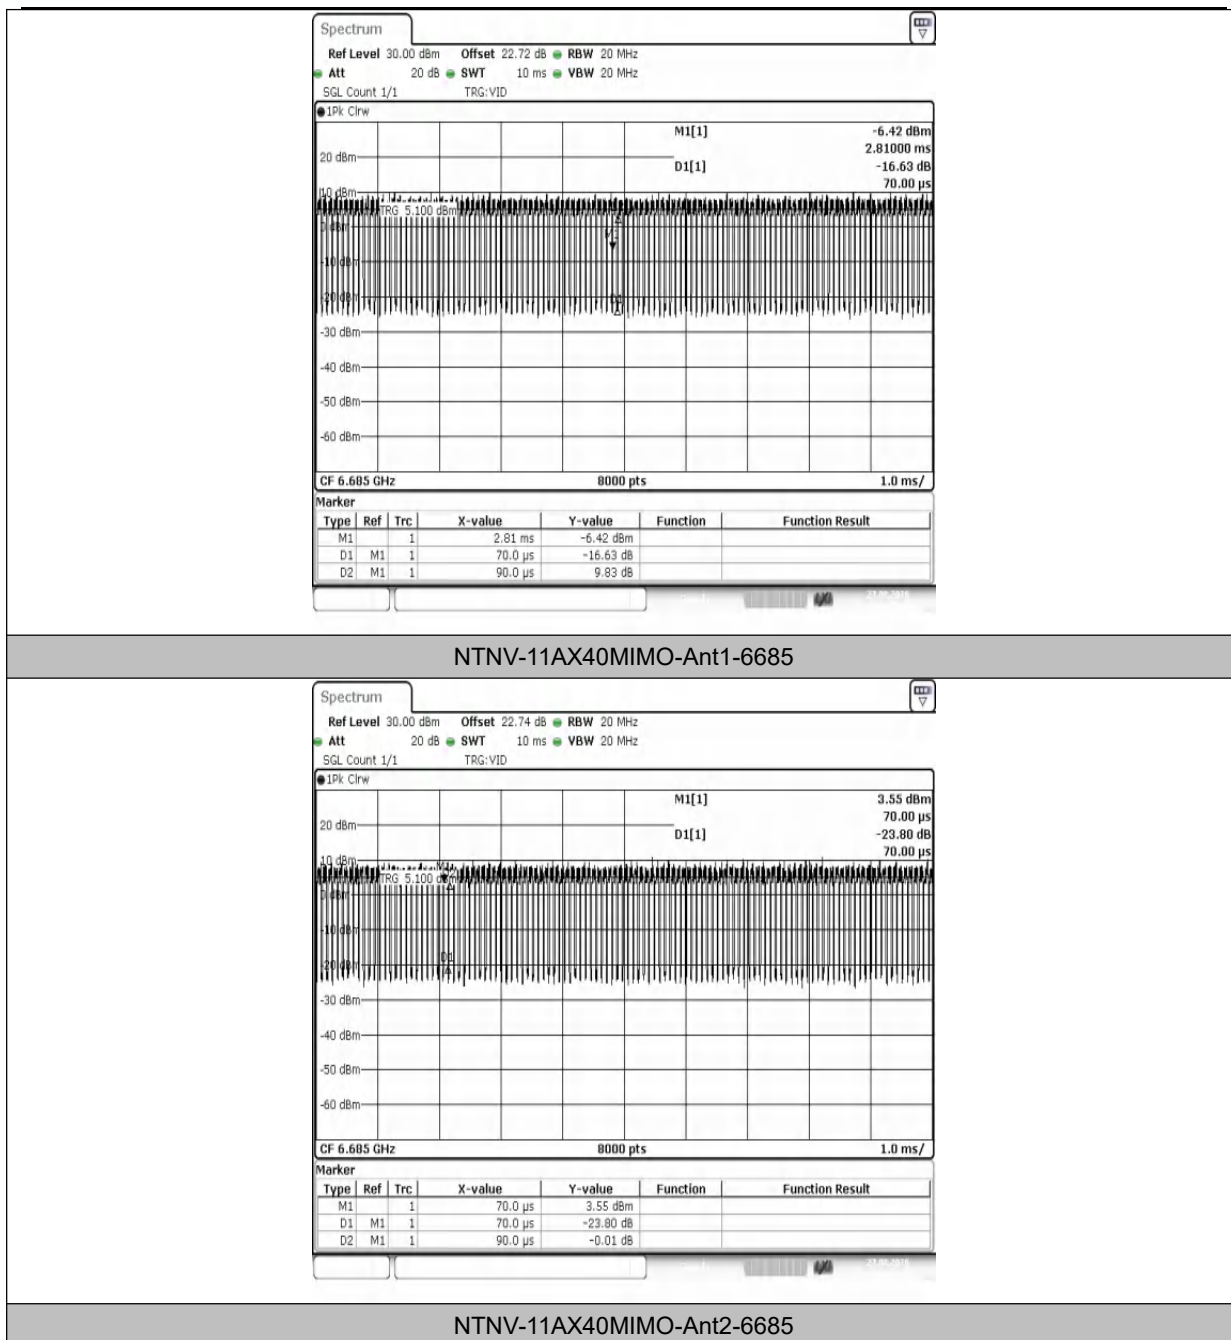

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

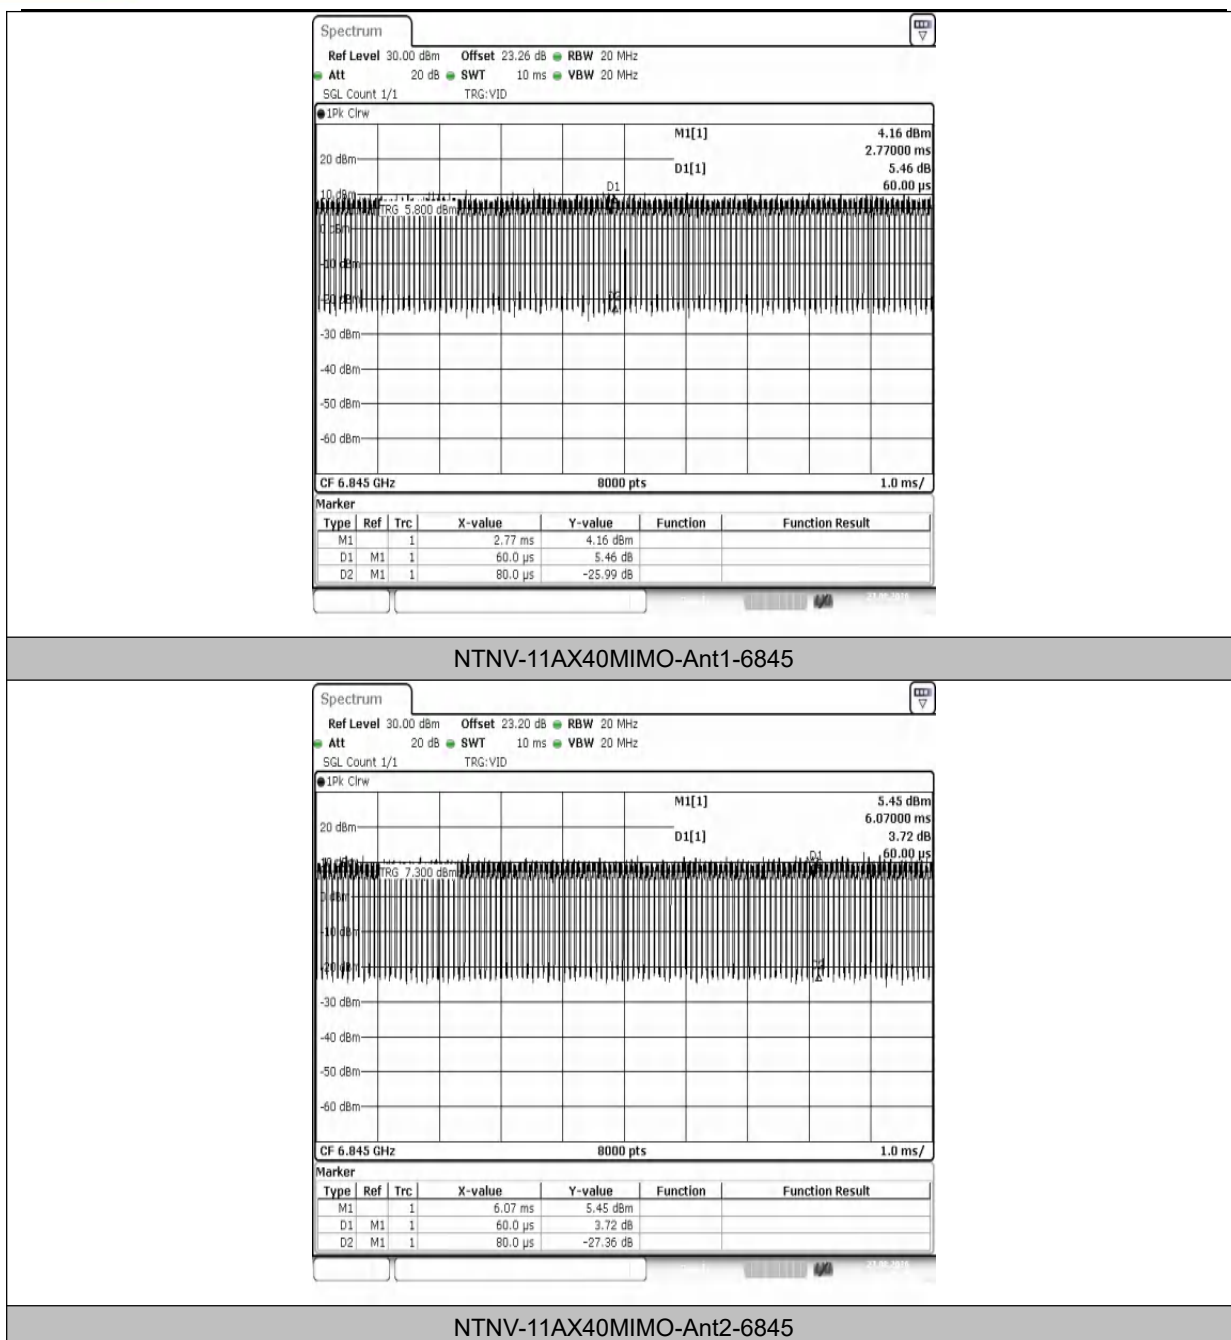

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

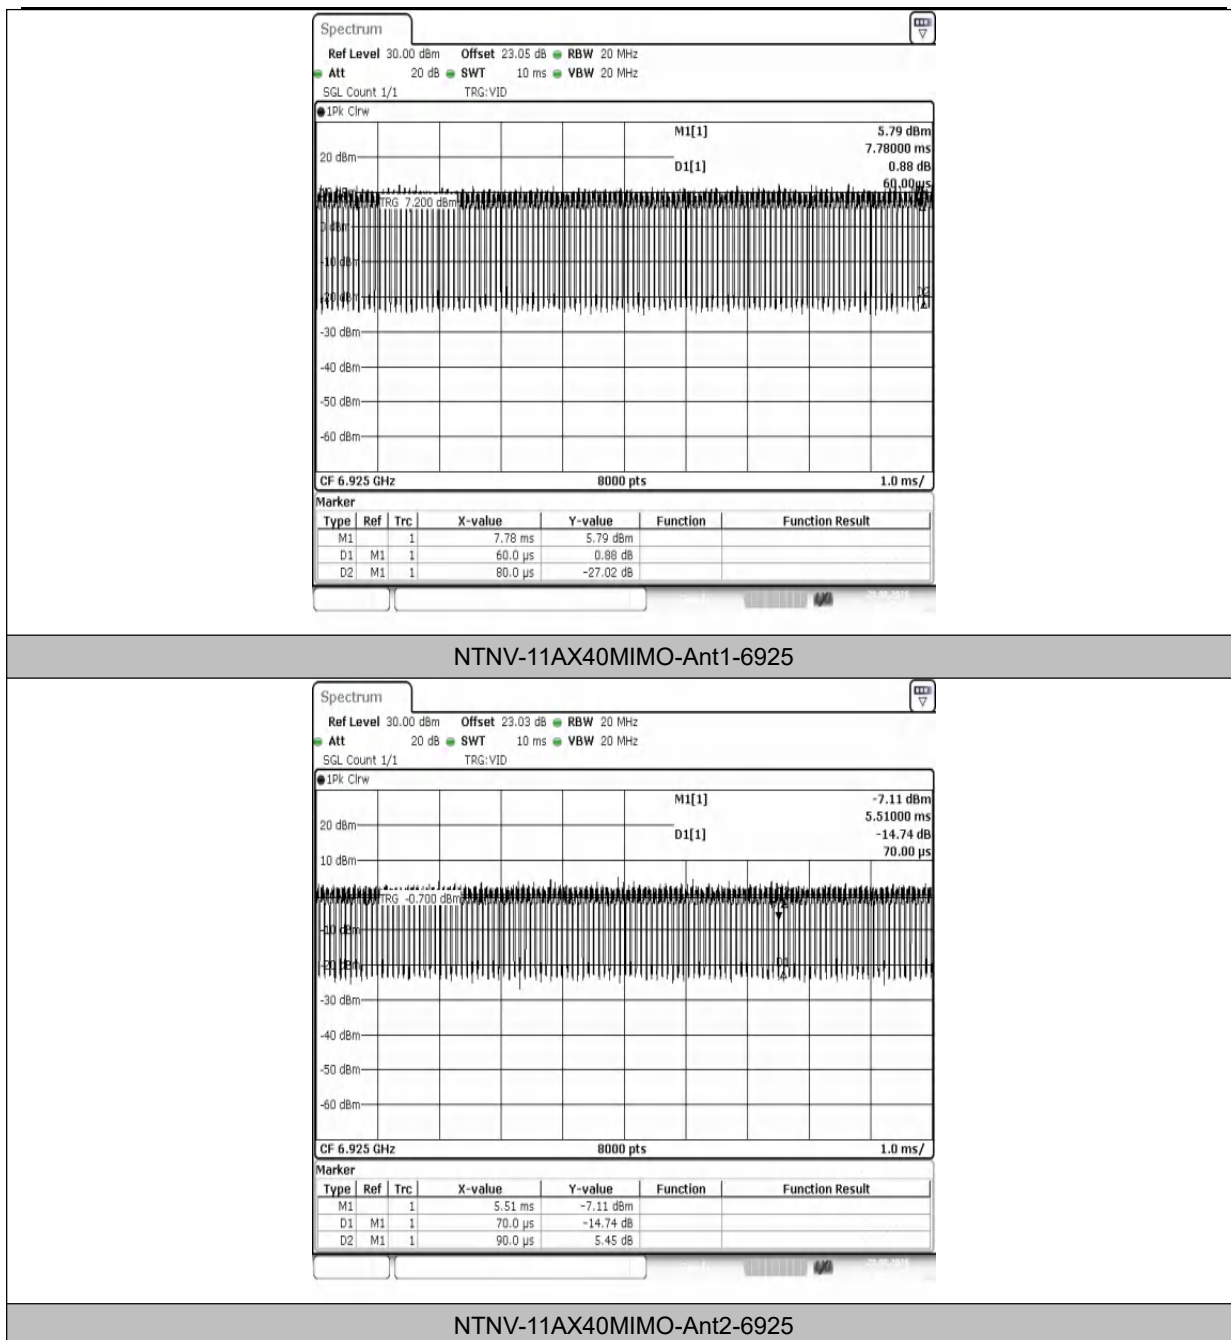

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

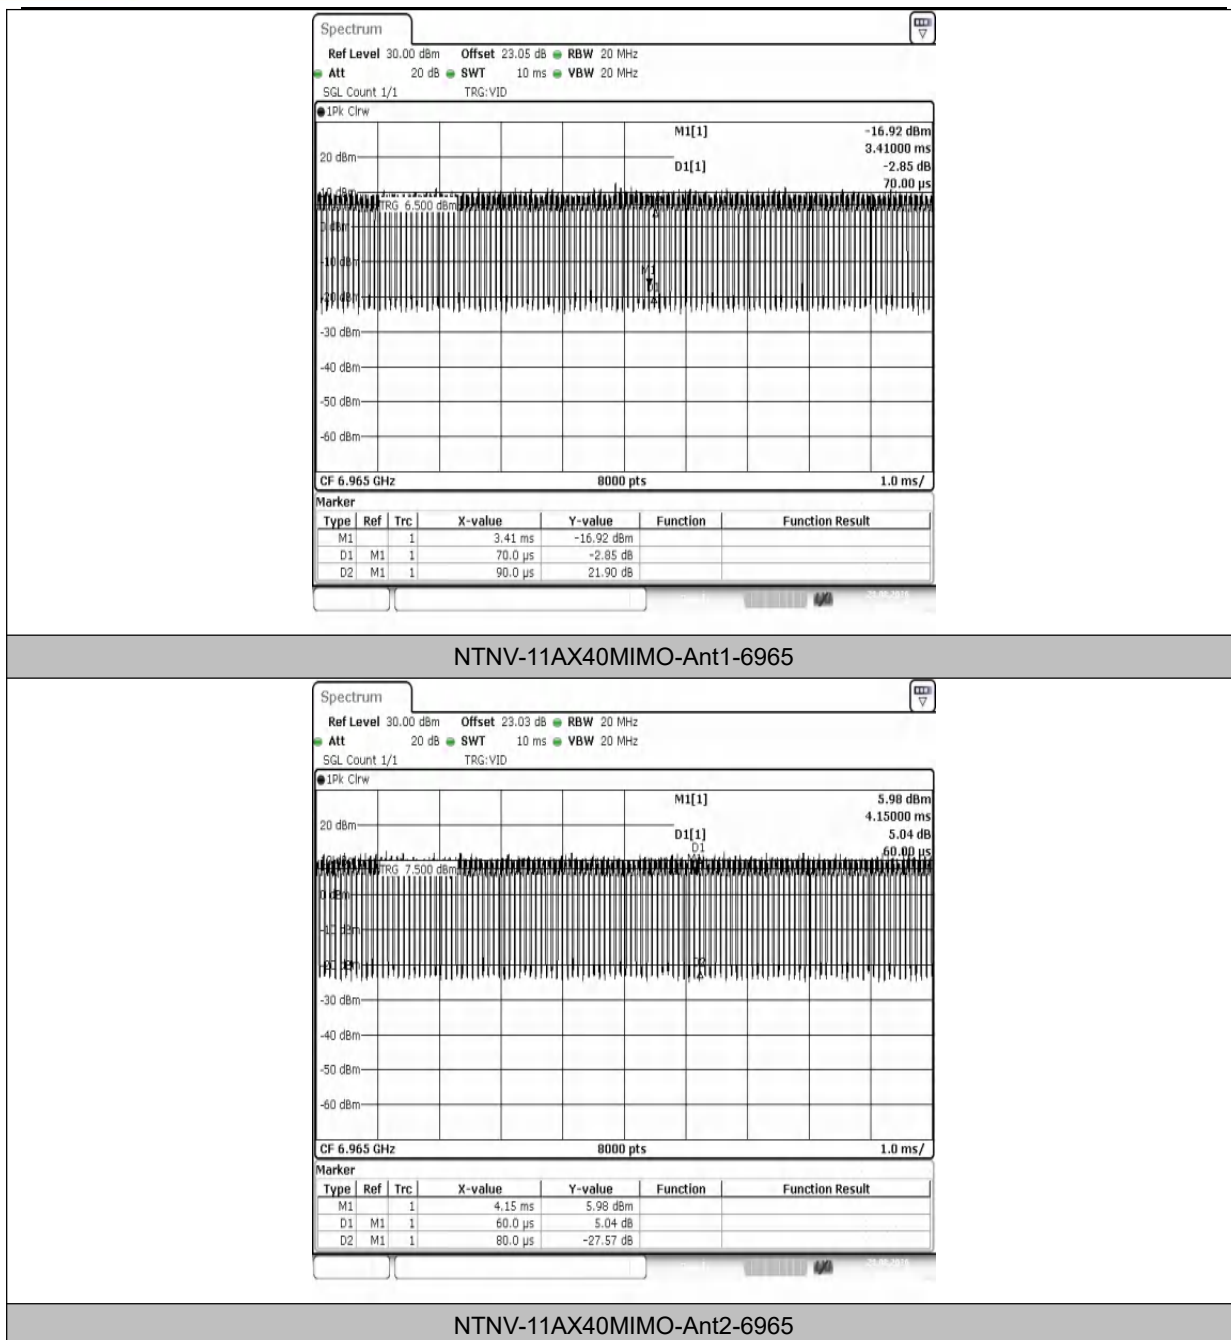

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

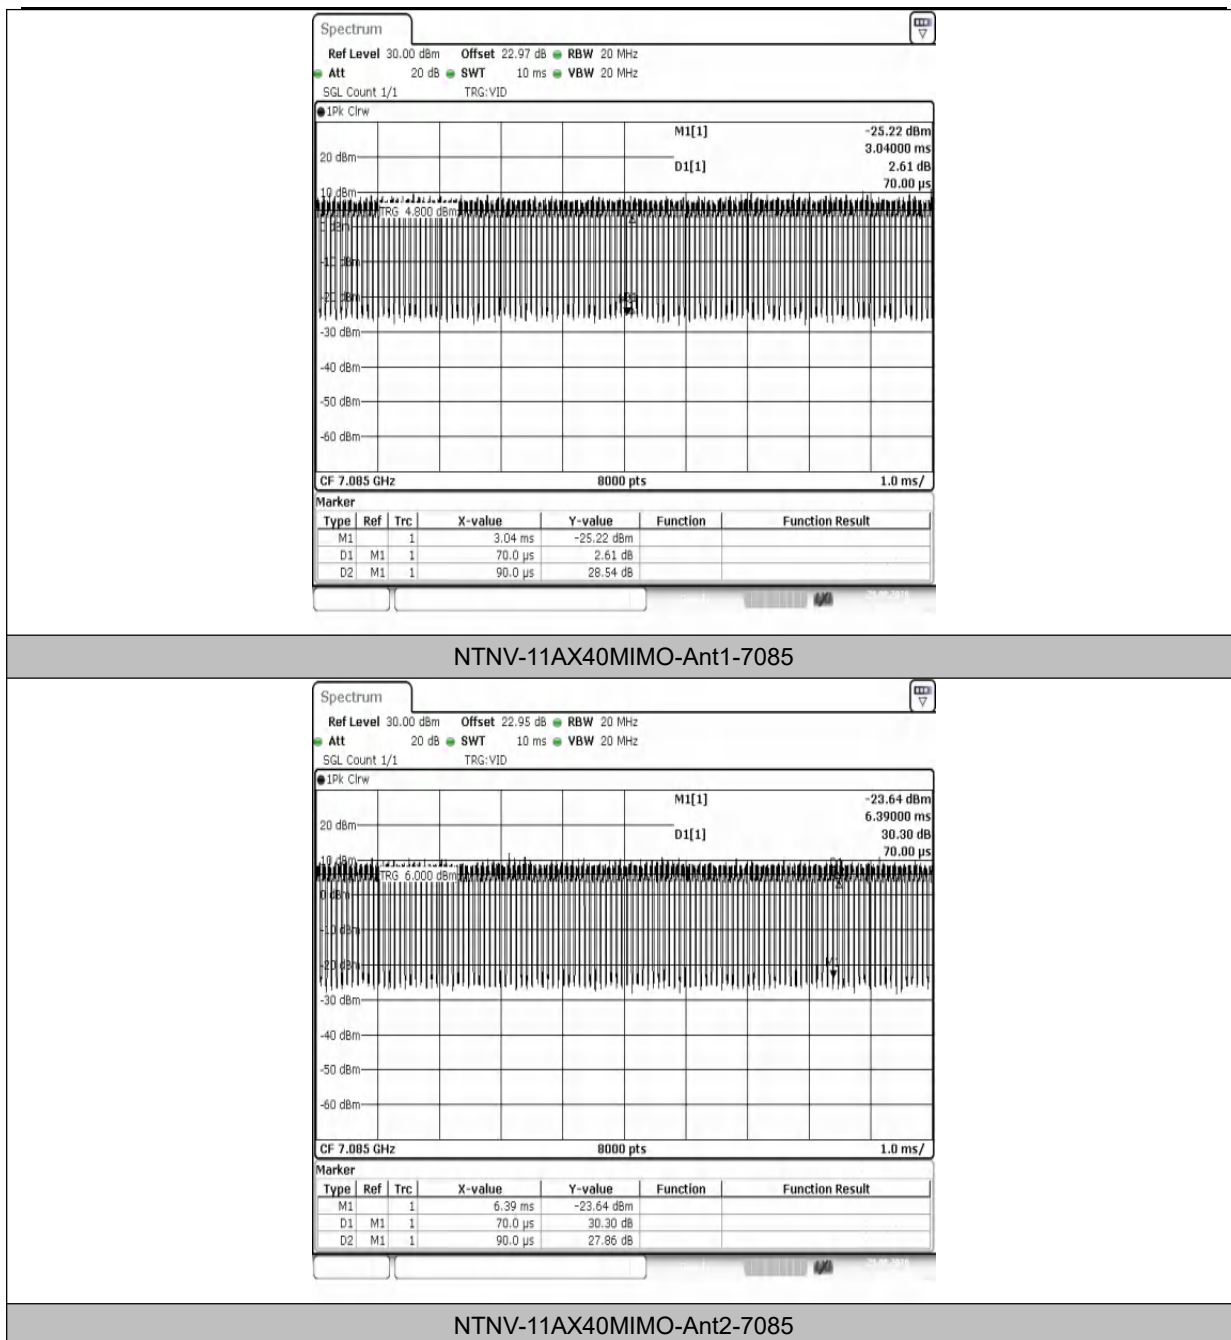

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

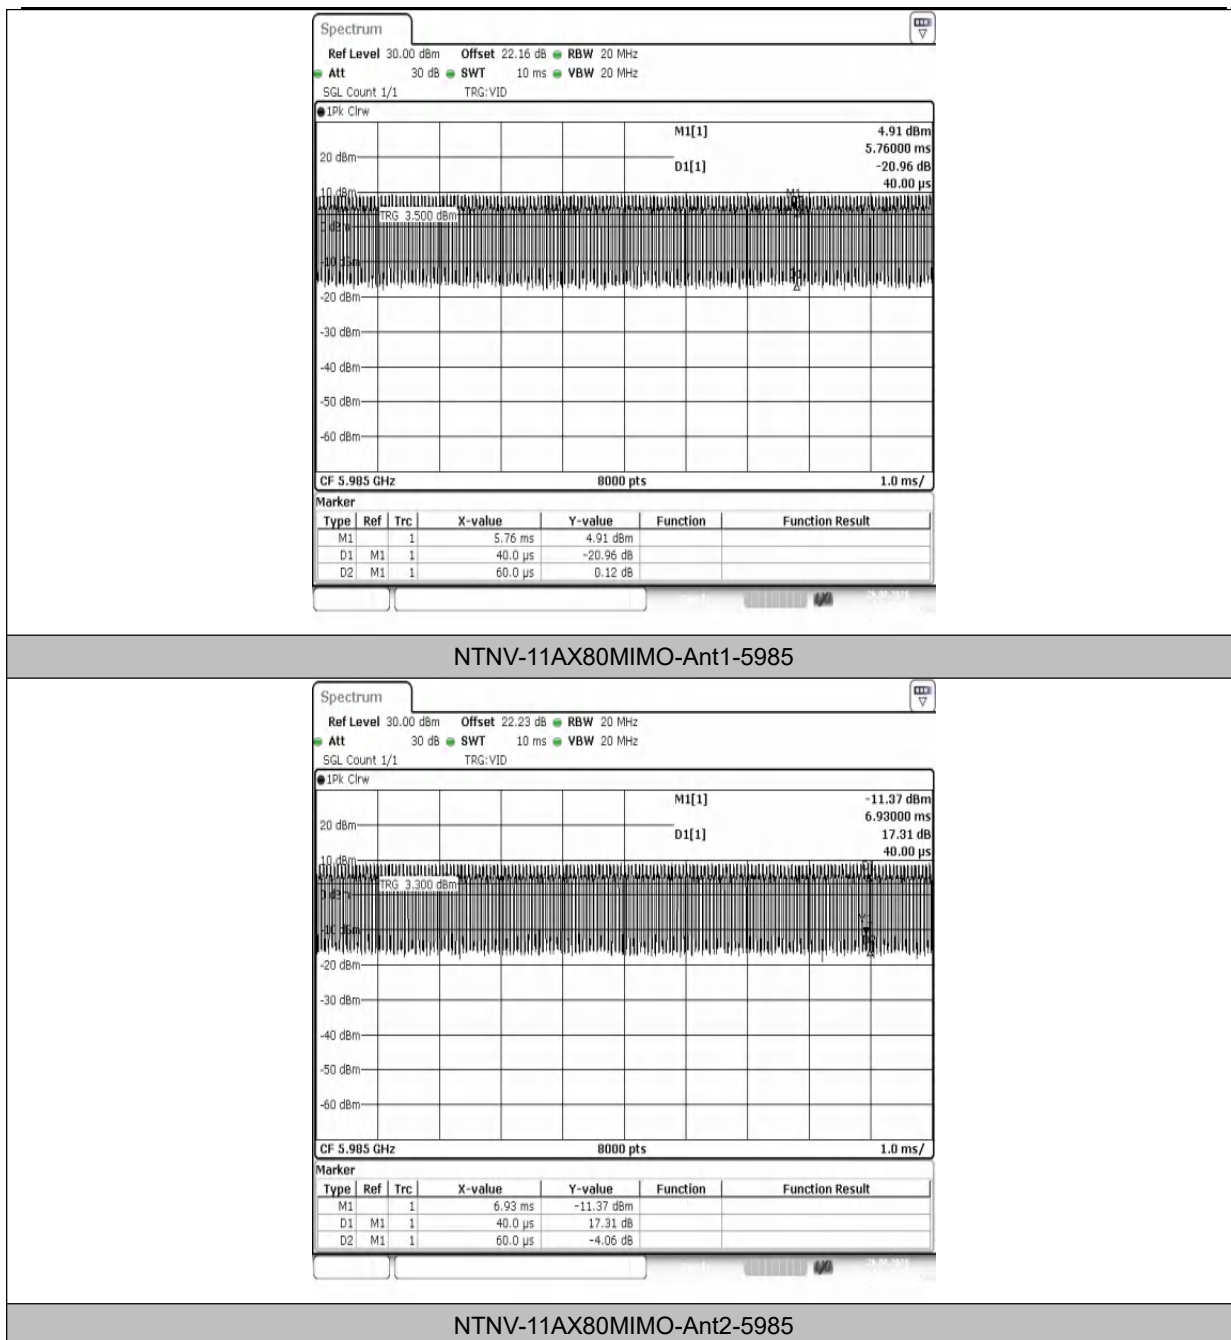

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

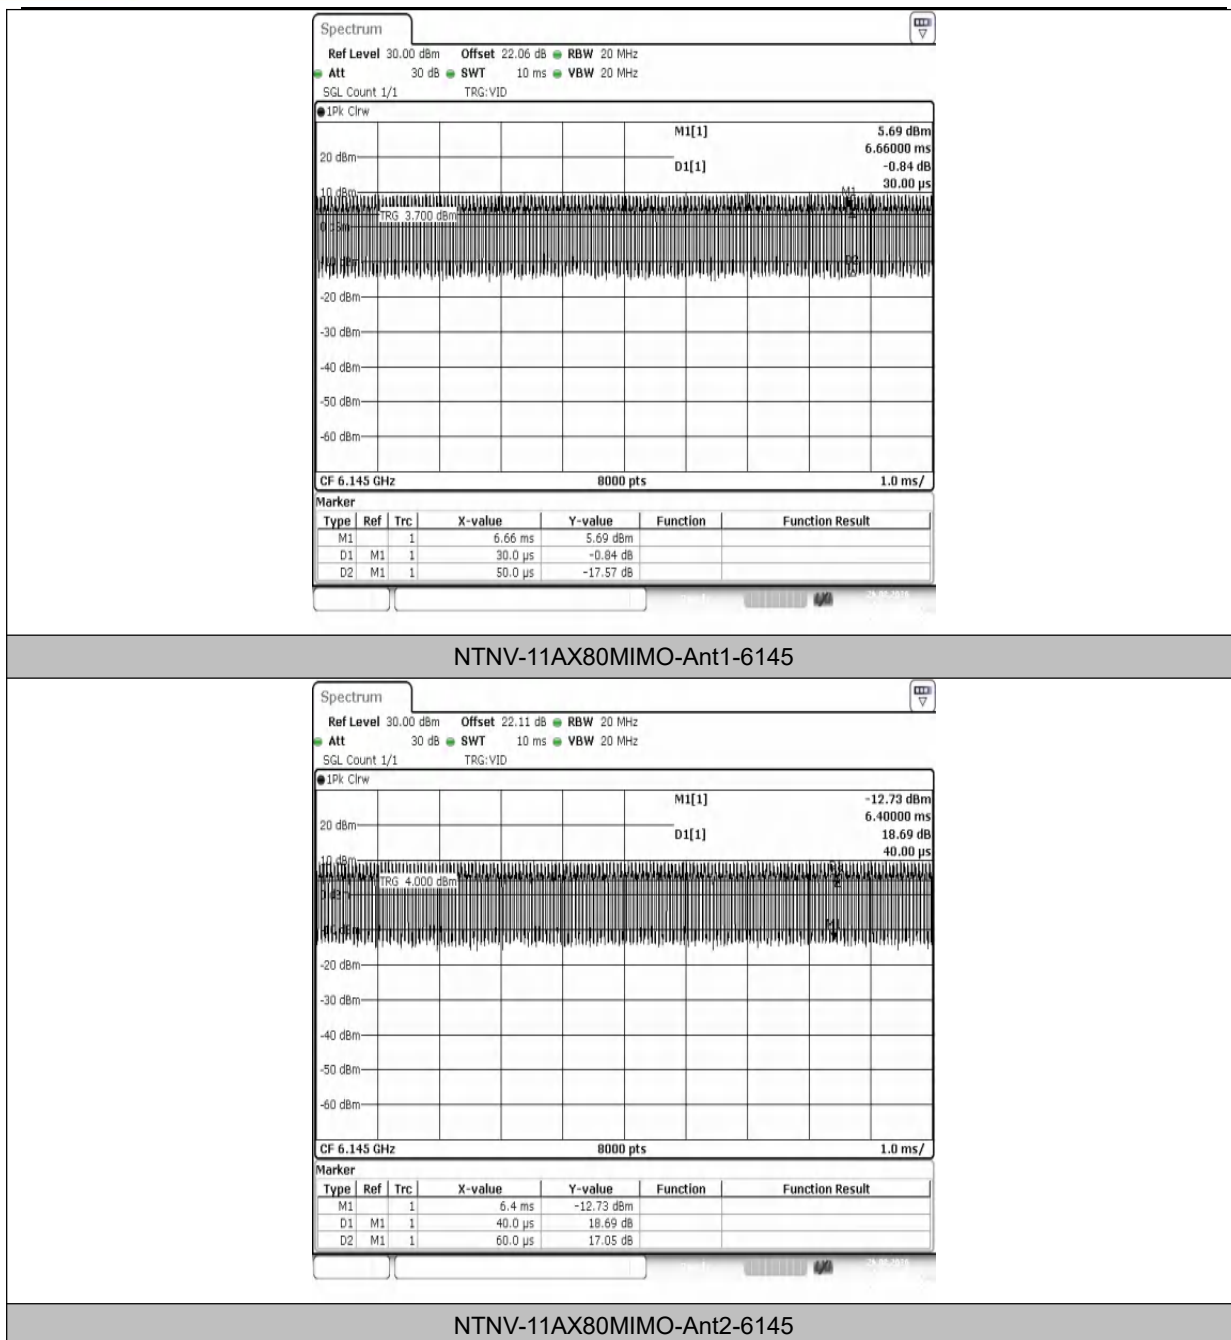

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

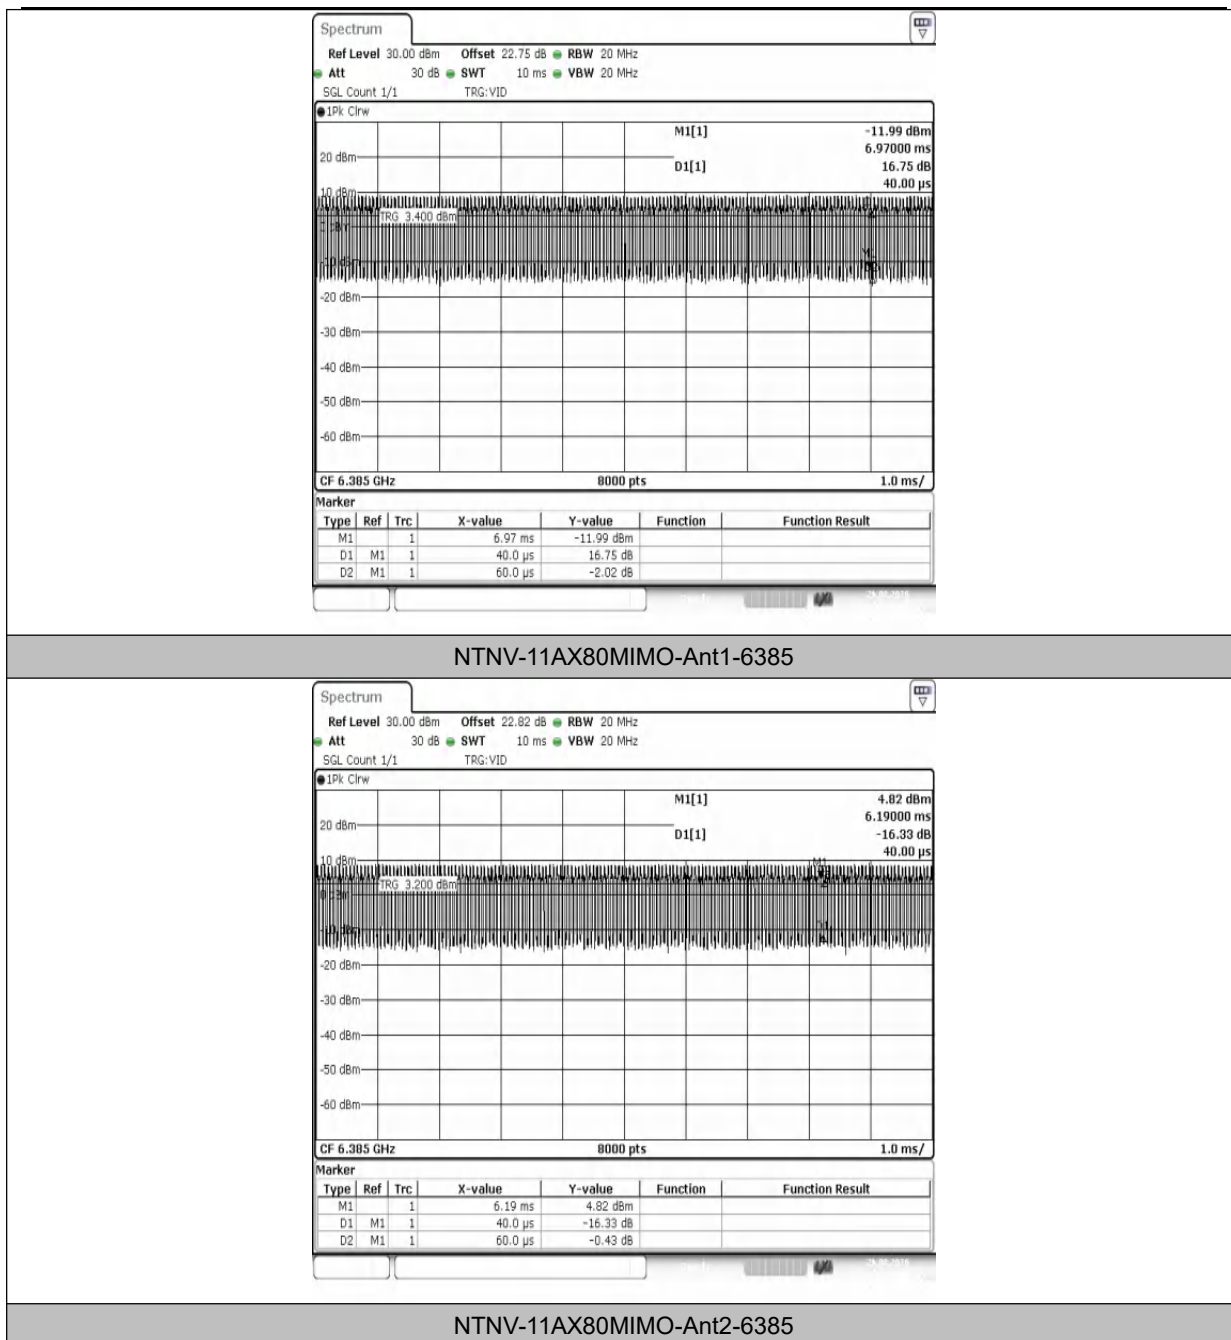

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

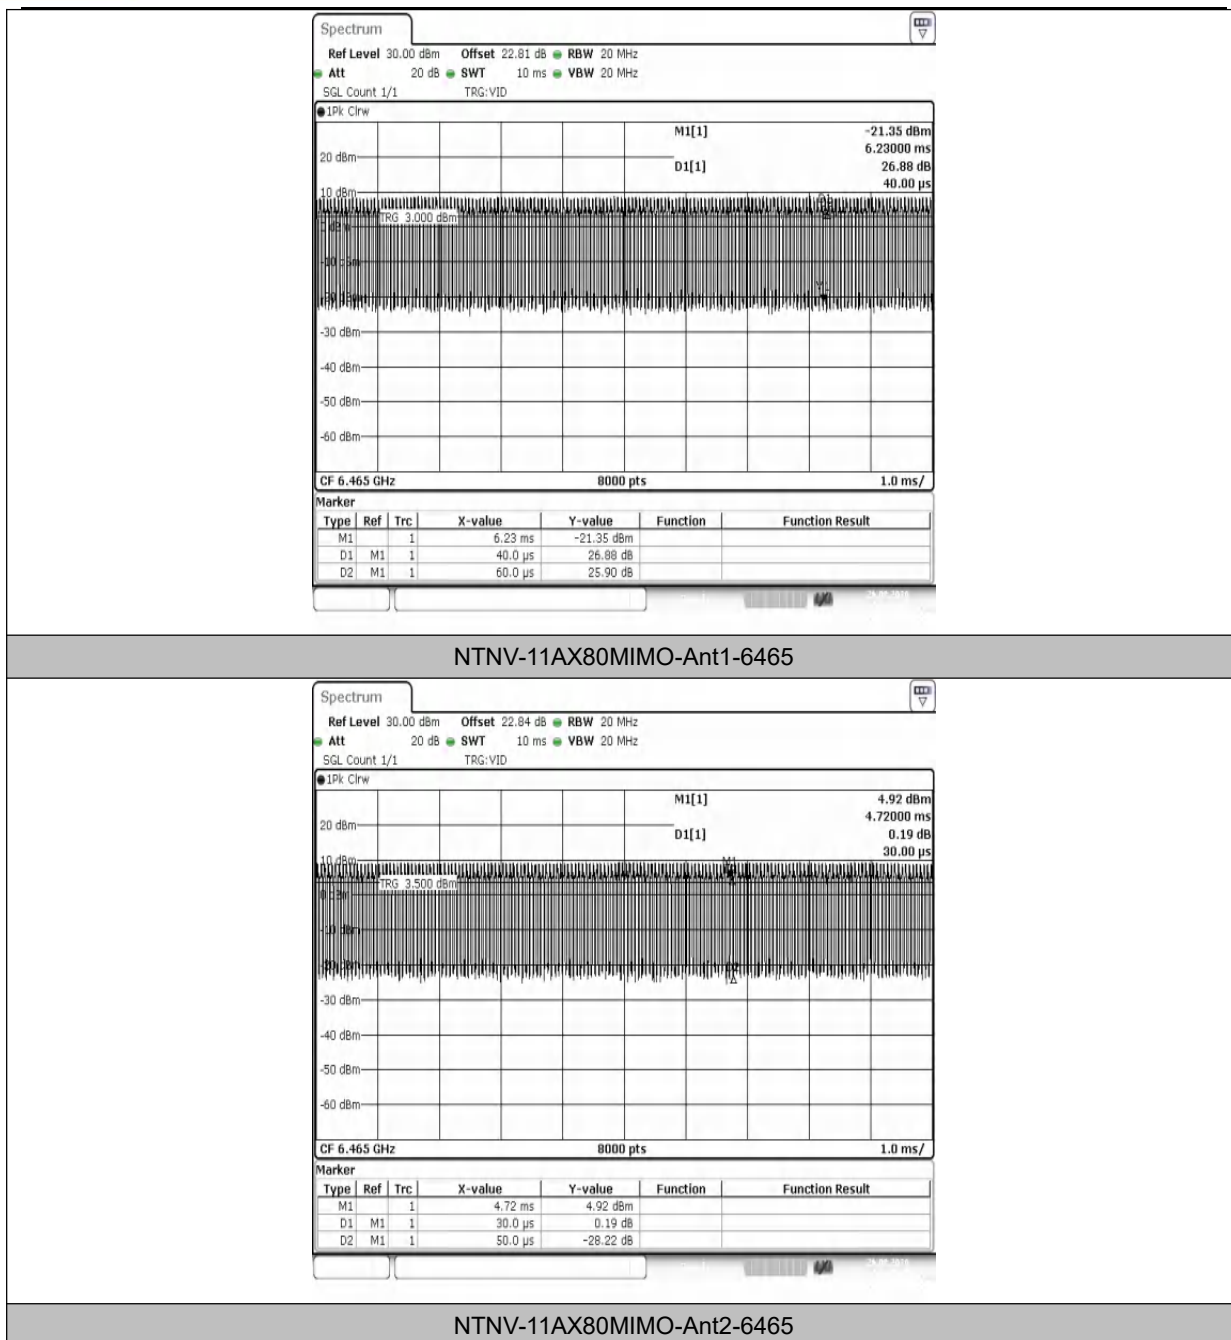

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

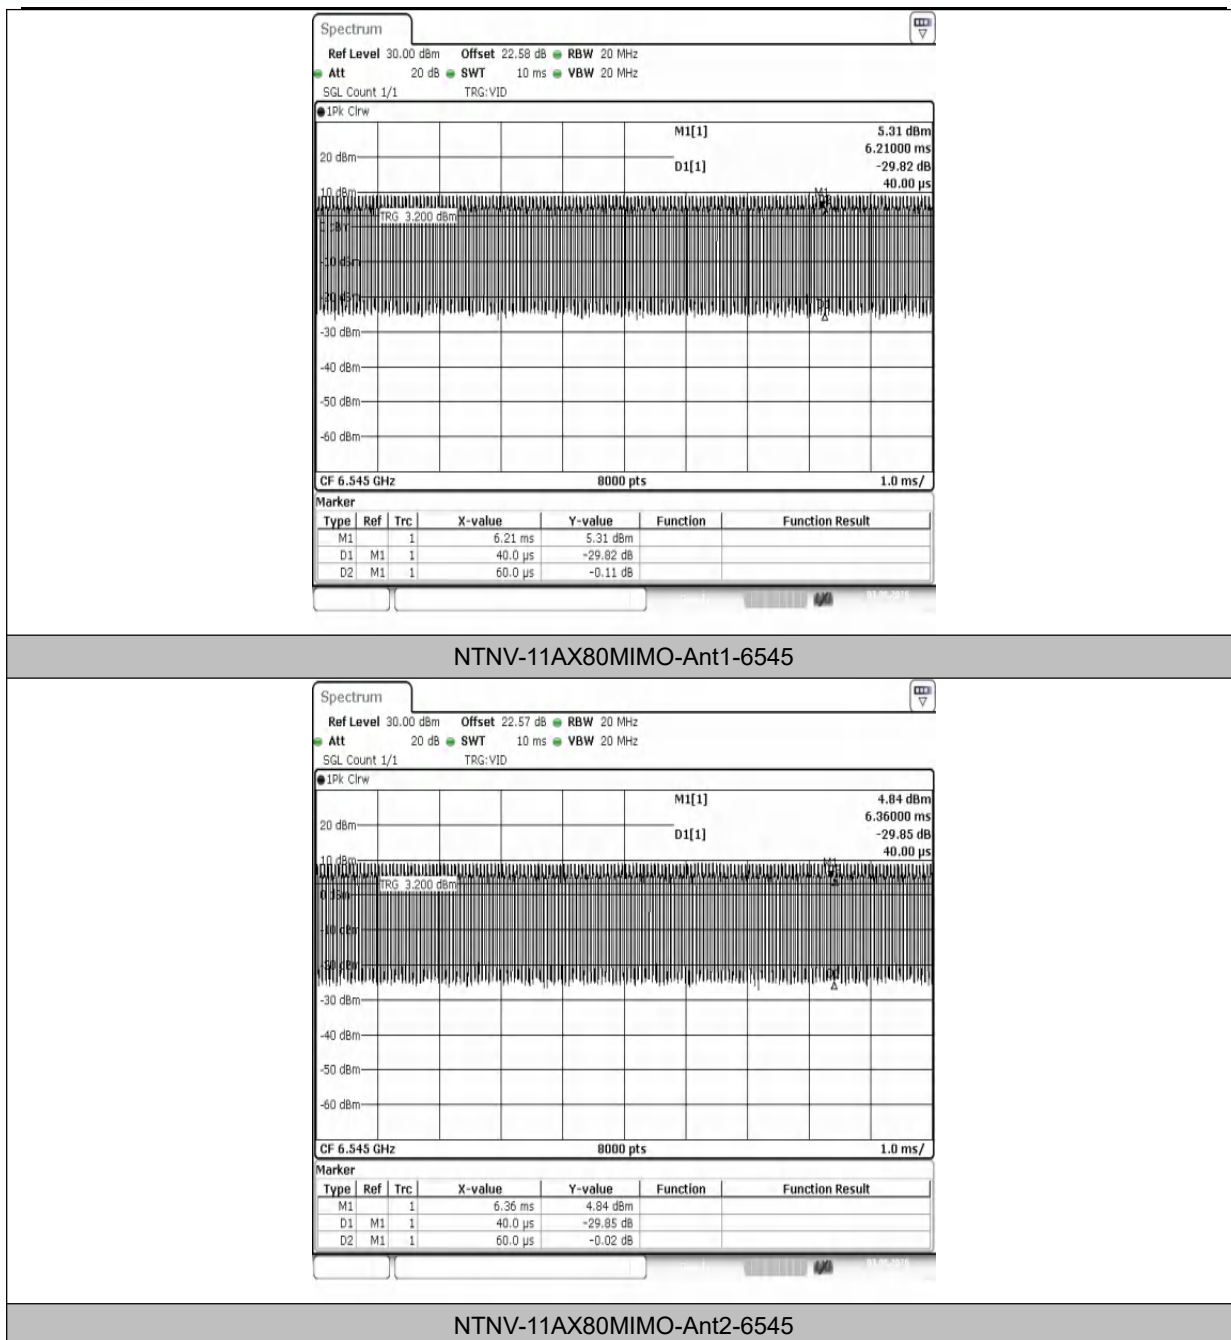

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

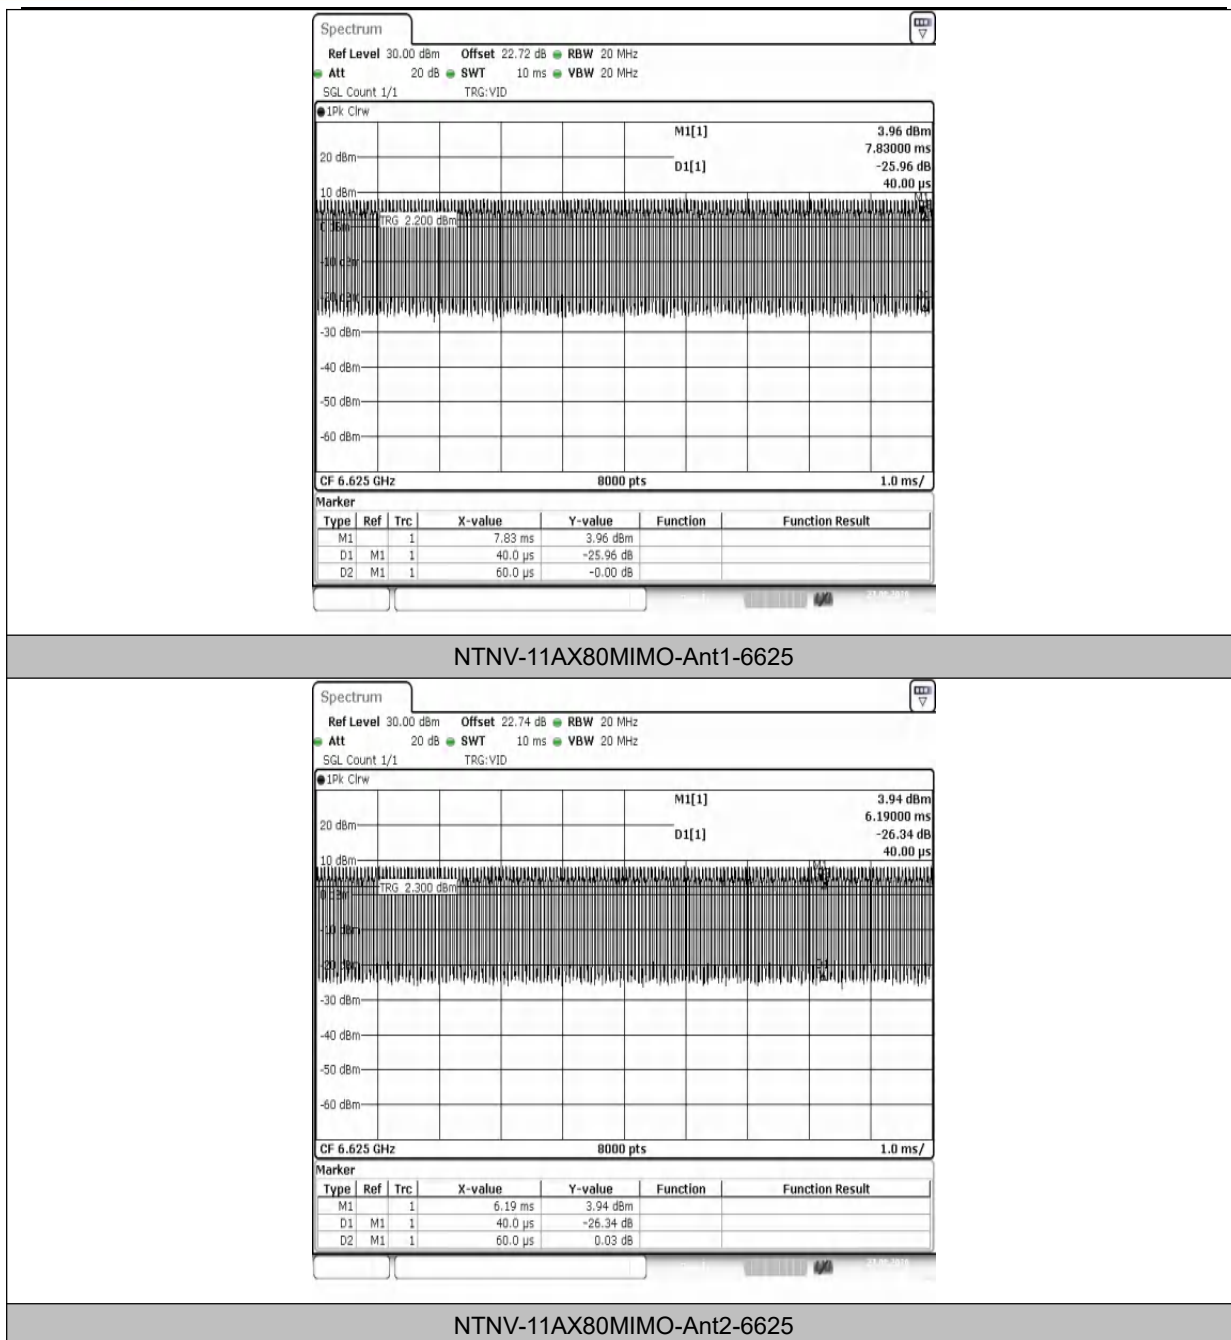

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

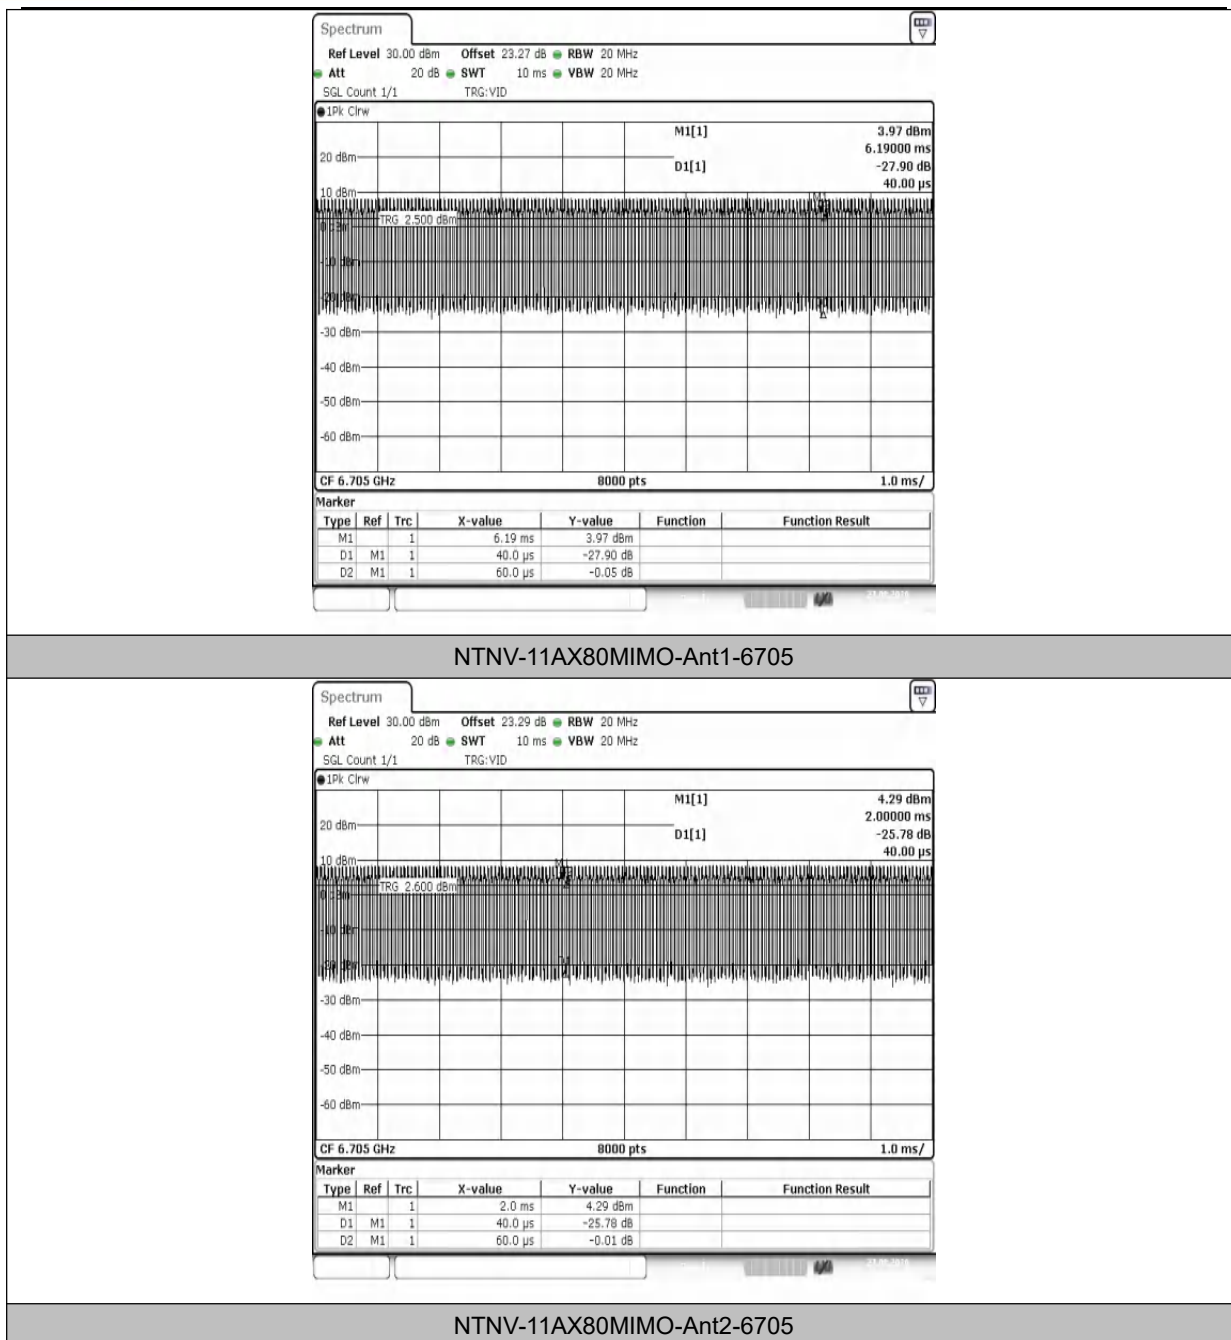

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

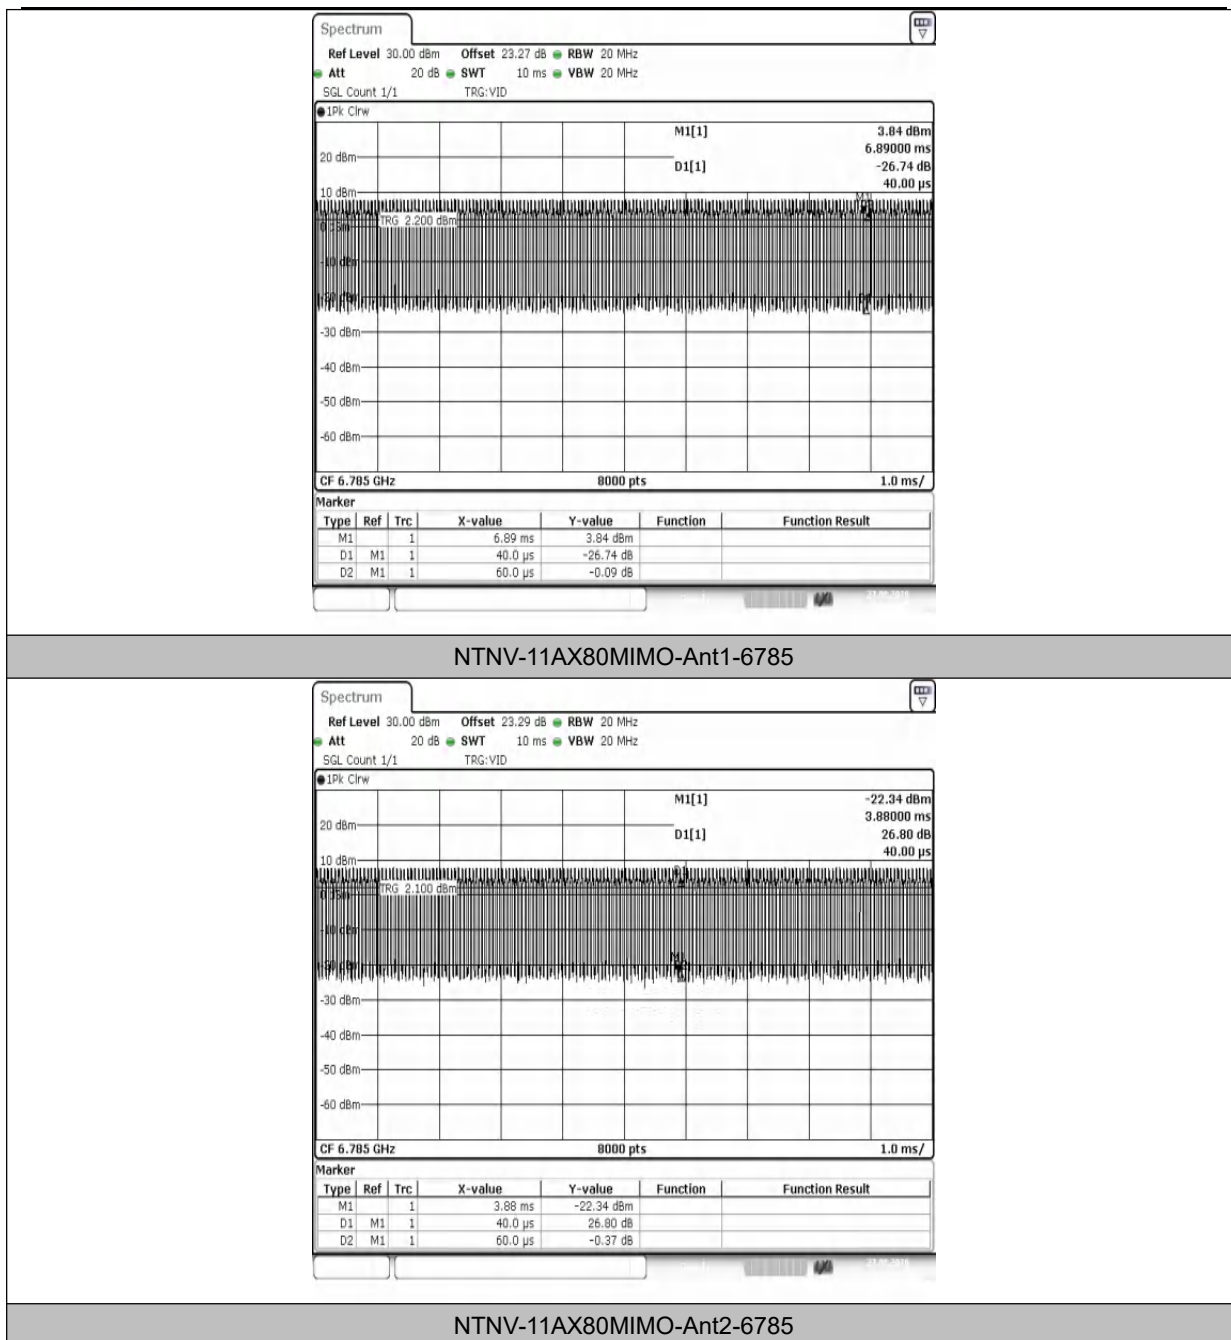

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

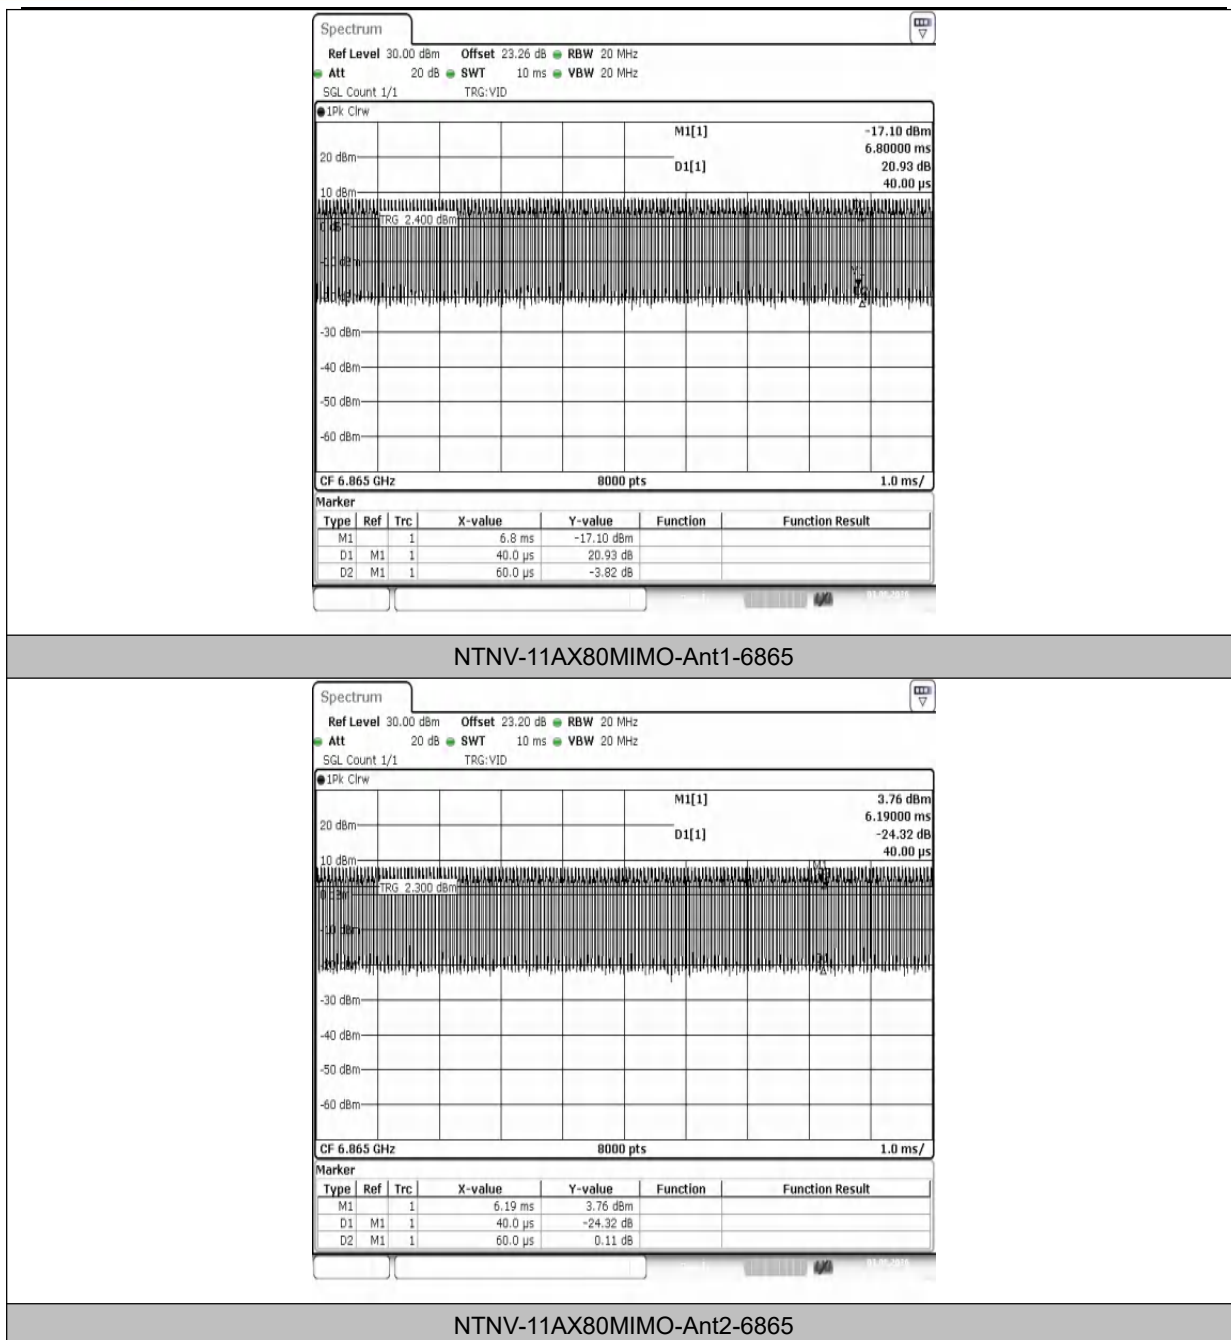

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

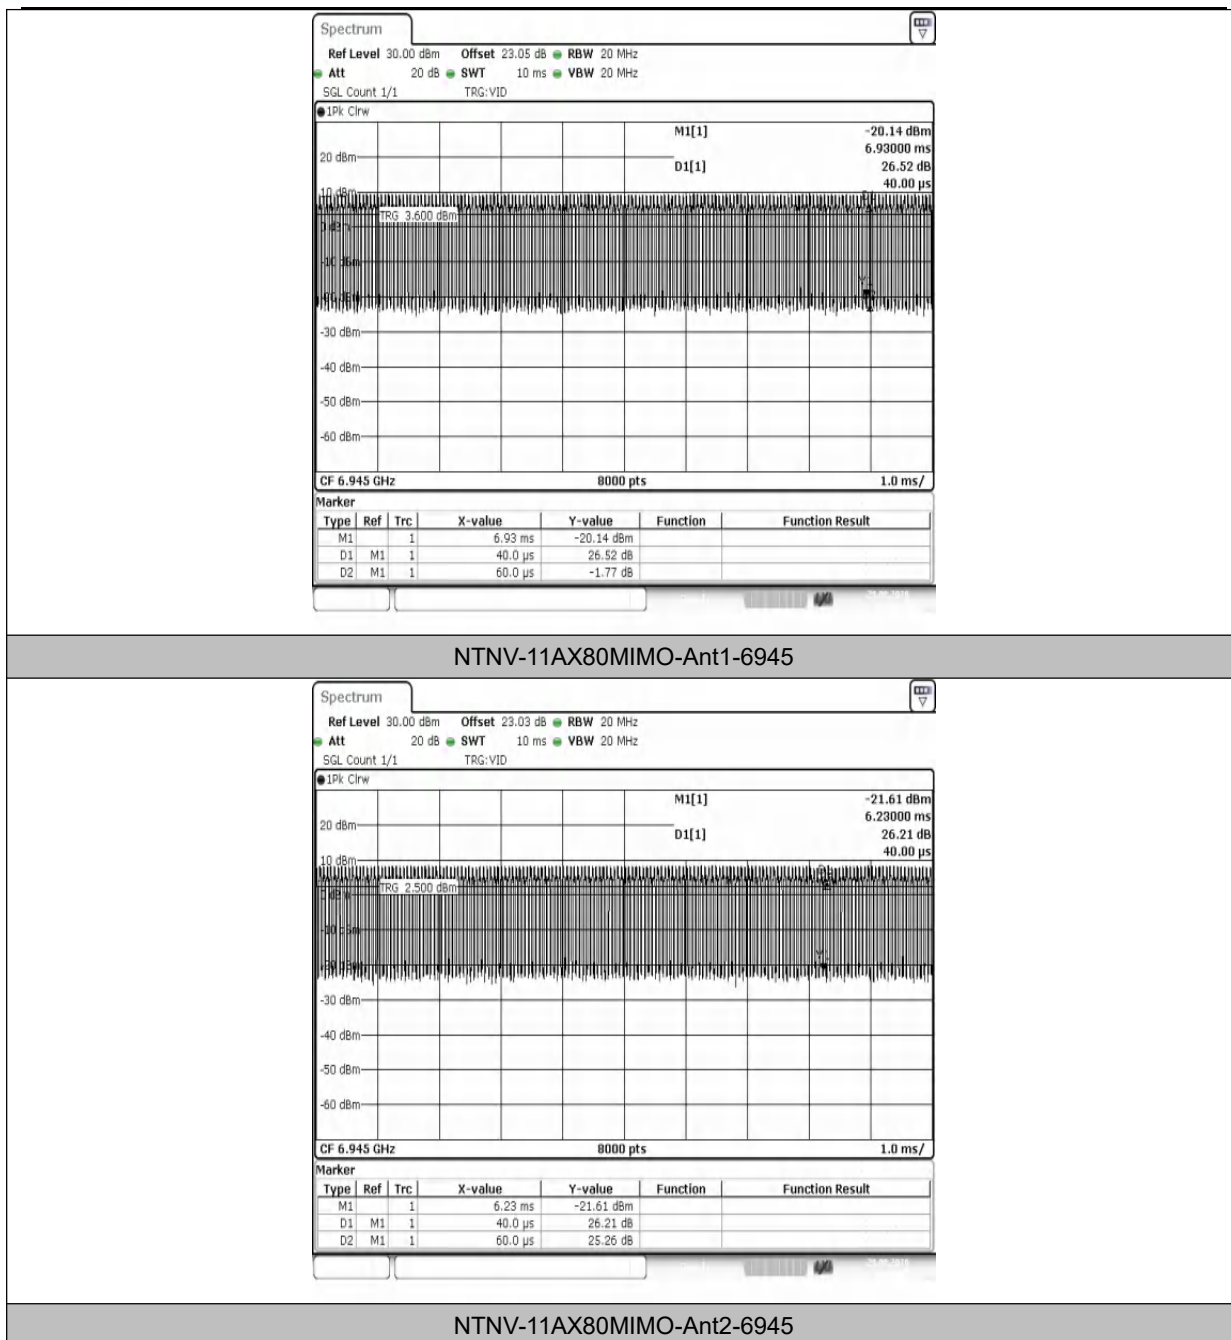

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

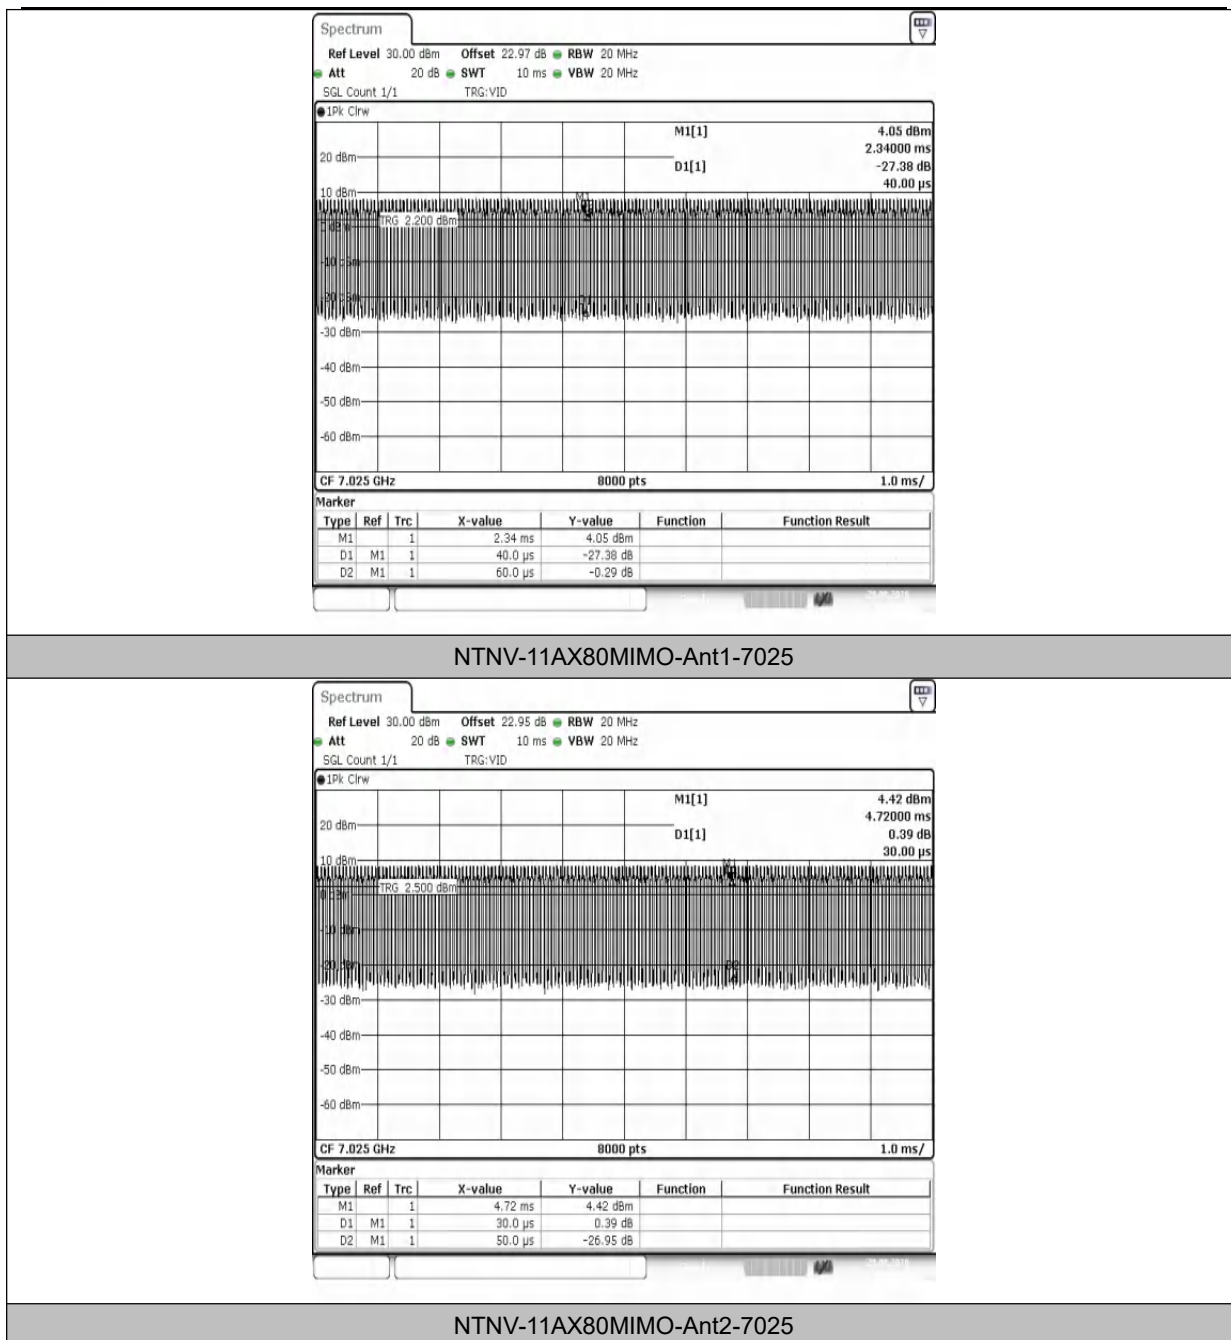

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: Maximum conducted output power

Test Result

Test Mode	Antenna	Frequency[MHz]	Set Power	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dBm]	Result [dBm]	Limit [dBm]	Gain [dBi]	EIRP [dBm]	EIRP Limit [dBm]	Verdict
11AX2 OMIMO	Ant1	5955	---	0.23	96.19	0.17	0.40	≤26.60	3.4	3.8	≤24.00	PASS
11AX2 OMIMO	Ant2	5955	---	-0.58	97.14	0.13	-0.45	≤26.60	3.4	2.95	≤24.00	PASS
11AX2 OMIMO	total	5955	---	---	---	---	3.01	≤26.60	6.41	9.42	≤24.00	PASS
11AX2 OMIMO	Ant1	6175	---	0.31	96.19	0.17	0.48	≤26.60	3.4	3.88	≤24.00	PASS
11AX2 OMIMO	Ant2	6175	---	-0.56	96.19	0.17	-0.39	≤26.60	3.4	3.01	≤24.00	PASS
11AX2 OMIMO	total	6175	---	---	---	---	3.08	≤26.60	6.41	9.49	≤24.00	PASS
11AX2 OMIMO	Ant1	6415	---	-0.10	96.19	0.17	0.07	≤26.60	3.4	3.47	≤24.00	PASS
11AX2 OMIMO	Ant2	6415	---	-0.32	97.14	0.13	-0.19	≤26.60	3.4	3.21	≤24.00	PASS
11AX2 OMIMO	total	6415	---	---	---	---	2.95	≤26.60	6.41	9.36	≤24.00	PASS
11AX2 OMIMO	Ant1	6435	---	-0.19	96.19	0.17	-0.02	≤26.68	3.32	3.3	≤24.00	PASS
11AX2 OMIMO	Ant2	6435	---	-0.18	96.19	0.17	-0.01	≤26.60	3.4	3.39	≤24.00	PASS
11AX2 OMIMO	total	6435	---	---	---	---	3.00	≤26.60	6.37	9.37	≤24.00	PASS
11AX2 OMIMO	Ant1	6475	---	-0.61	96.19	0.17	-0.44	≤26.68	3.32	2.88	≤24.00	PASS
11AX2 OMIMO	Ant2	6475	---	-0.33	96.19	0.17	-0.16	≤26.60	3.4	3.24	≤24.00	PASS
11AX2 OMIMO	total	6475	---	---	---	---	2.71	≤26.60	6.37	9.08	≤24.00	PASS
11AX2 OMIMO	Ant2	6515	---	-0.13	96.19	0.17	0.04	≤26.60	3.4	3.44	≤24.00	PASS
11AX2 OMIMO	total	6515	---	---	---	---	2.76	≤26.60	6.37	9.13	≤24.00	PASS
11AX2	Ant1	6515	---	-0.74	96.19	0.17	-0.57	≤26.68	3.32	2.75	≤24.00	PASS

0MIMO												
11AX2 0MIMO	Ant1	6535	---	-0.47	96.19	0.17	-0.30	≤26.60	3.4	3.1	≤24.00	PASS
11AX2 0MIMO	Ant2	6535	---	0.04	96.19	0.17	0.21	≤26.60	3.4	3.61	≤24.00	PASS
11AX2 0MIMO	total	6535	---	---	---	---	2.97	≤26.60	6.41	9.38	≤24.00	PASS
11AX2 0MIMO	Ant1	6695	---	-0.65	96.19	0.17	-0.48	≤26.60	3.4	2.92	≤24.00	PASS
11AX2 0MIMO	Ant2	6695	---	-1.81	96.19	0.17	-1.64	≤26.60	3.4	1.76	≤24.00	PASS
11AX2 0MIMO	total	6695	---	---	---	---	1.99	≤26.60	6.41	8.4	≤24.00	PASS
11AX2 0MIMO	Ant1	6855	---	0.06	96.19	0.17	0.23	≤26.60	3.4	3.63	≤24.00	PASS
11AX2 0MIMO	Ant2	6855	---	0.52	96.19	0.17	0.69	≤26.60	3.4	4.09	≤24.00	PASS
11AX2 0MIMO	total	6855	---	---	---	---	3.48	≤26.60	6.41	9.89	≤24.00	PASS
11AX2 0MIMO	Ant1	6875	---	-0.51	97.14	0.13	-0.38	≤26.60	3.4	3.02	≤24.00	PASS
11AX2 0MIMO	Ant2	6875	---	-1.14	96.19	0.17	-0.97	≤26.60	3.4	2.43	≤24.00	PASS
11AX2 0MIMO	total	6875	---	---	---	---	2.35	≤26.60	6.41	8.76	≤24.00	PASS
11AX2 0MIMO	Ant1	6895	---	0.00	97.14	0.13	0.13	≤26.60	3.4	3.53	≤24.00	PASS
11AX2 0MIMO	Ant2	6895	---	-0.91	97.14	0.13	-0.78	≤26.60	3.4	2.62	≤24.00	PASS
11AX2 0MIMO	total	6895	---	---	---	---	2.71	≤26.60	6.41	9.12	≤24.00	PASS
11AX2 0MIMO	Ant1	6995	---	-0.63	96.19	0.17	-0.46	≤26.60	3.4	2.94	≤24.00	PASS
11AX2 0MIMO	Ant2	6995	---	-0.40	97.14	0.13	-0.27	≤26.60	3.4	3.13	≤24.00	PASS
11AX2 0MIMO	total	6995	---	---	---	---	2.65	≤26.60	6.41	9.06	≤24.00	PASS
11AX2 0MIMO	Ant1	7115	---	0.33	96.19	0.17	0.50	≤26.60	3.4	3.9	≤24.00	PASS
11AX2 0MIMO	Ant2	7115	---	-0.71	96.19	0.17	-0.54	≤26.60	3.4	2.86	≤24.00	PASS
11AX2 0MIMO	total	7115	---	---	---	---	3.02	≤26.60	6.41	9.43	≤24.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX4 0MIMO	Ant1	5965	---	0.79	77.78	1.09	1.88	≤26.60	3.4	5.28	≤24.00	PASS
11AX4 0MIMO	Ant2	5965	---	0.45	75.00	1.25	1.70	≤26.60	3.4	5.1	≤24.00	PASS
11AX4 0MIMO	total	5965	---	---	---	---	4.80	≤26.60	6.41	11.21	≤24.00	PASS
11AX4 0MIMO	Ant1	6165	---	0.44	77.78	1.09	1.53	≤26.60	3.4	4.93	≤24.00	PASS
11AX4 0MIMO	Ant2	6165	---	0.52	75.00	1.25	1.77	≤26.60	3.4	5.17	≤24.00	PASS
11AX4 0MIMO	total	6165	---	---	---	---	4.66	≤26.60	6.41	11.07	≤24.00	PASS
11AX4 0MIMO	Ant1	6405	---	0.02	75.00	1.25	1.27	≤26.60	3.4	4.67	≤24.00	PASS
11AX4 0MIMO	Ant2	6405	---	0.23	77.78	1.09	1.32	≤26.60	3.4	4.72	≤24.00	PASS
11AX4 0MIMO	total	6405	---	---	---	---	4.31	≤26.60	6.41	10.72	≤24.00	PASS
11AX4 0MIMO	Ant1	6445	---	-0.26	75.00	1.25	0.99	≤26.68	3.32	4.31	≤24.00	PASS
11AX4 0MIMO	Ant2	6445	---	0.29	75.00	1.25	1.54	≤26.60	3.4	4.94	≤24.00	PASS
11AX4 0MIMO	total	6445	---	---	---	---	4.28	≤26.60	6.37	10.65	≤24.00	PASS
11AX4 0MIMO	Ant1	6485	---	-0.86	77.78	1.09	0.23	≤26.68	3.32	3.55	≤24.00	PASS
11AX4 0MIMO	Ant2	6485	---	0.59	77.78	1.09	1.68	≤26.60	3.4	5.08	≤24.00	PASS
11AX4 0MIMO	total	6485	---	---	---	---	4.03	≤26.60	6.37	10.4	≤24.00	PASS
11AX4 0MIMO	Ant1	6565	---	-0.91	77.78	1.09	0.18	≤26.60	3.4	3.58	≤24.00	PASS
11AX4 0MIMO	Ant2	6565	---	0.72	77.78	1.09	1.81	≤26.60	3.4	5.21	≤24.00	PASS
11AX4 0MIMO	total	6565	---	---	---	---	4.08	≤26.60	6.41	10.49	≤24.00	PASS
11AX4 0MIMO	Ant1	6685	---	-0.11	77.78	1.09	0.98	≤26.60	3.4	4.38	≤24.00	PASS
11AX4 0MIMO	Ant2	6685	---	-0.33	77.78	1.09	0.76	≤26.60	3.4	4.16	≤24.00	PASS
11AX4 0MIMO	total	6685	---	---	---	---	3.88	≤26.60	6.41	10.29	≤24.00	PASS
11AX4	Ant1	6845	---	0.28	75.00	1.25	1.53	≤26.60	3.4	4.93	≤24.00	PASS

0MIMO												
11AX4 0MIMO	Ant2	6845	---	-0.39	75.00	1.25	0.86	≤26.60	3.4	4.26	≤24.00	PASS
11AX4 0MIMO	total	6845	---	---	---	---	4.22	≤26.60	6.41	10.63	≤24.00	PASS
11AX4 0MIMO	Ant1	6925	---	0.29	75.00	1.25	1.54	≤26.60	3.4	4.94	≤24.00	PASS
11AX4 0MIMO	Ant2	6925	---	0.44	77.78	1.09	1.53	≤26.60	3.4	4.93	≤24.00	PASS
11AX4 0MIMO	total	6925	---	---	---	---	4.55	≤26.60	6.41	10.96	≤24.00	PASS
11AX4 0MIMO	Ant1	6965	---	0.18	77.78	1.09	1.27	≤26.60	3.4	4.67	≤24.00	PASS
11AX4 0MIMO	Ant2	6965	---	0.84	75.00	1.25	2.09	≤26.60	3.4	5.49	≤24.00	PASS
11AX4 0MIMO	total	6965	---	---	---	---	4.71	≤26.60	6.41	11.12	≤24.00	PASS
11AX4 0MIMO	Ant1	7085	---	0.62	77.78	1.09	1.71	≤26.60	3.4	5.11	≤24.00	PASS
11AX4 0MIMO	Ant2	7085	---	1.21	77.78	1.09	2.30	≤26.60	3.4	5.7	≤24.00	PASS
11AX4 0MIMO	total	7085	---	---	---	---	5.03	≤26.60	6.41	11.44	≤24.00	PASS
11AX8 0MIMO	Ant1	5985	---	2.13	66.67	1.76	3.89	≤26.60	3.4	7.29	≤24.00	PASS
11AX8 0MIMO	Ant2	5985	---	1.67	66.67	1.76	3.43	≤26.60	3.4	6.83	≤24.00	PASS
11AX8 0MIMO	total	5985	---	---	---	---	6.68	≤26.60	6.41	13.09	≤24.00	PASS
11AX8 0MIMO	Ant1	6145	---	2.03	60.00	2.22	4.25	≤26.60	3.4	7.65	≤24.00	PASS
11AX8 0MIMO	Ant2	6145	---	1.44	66.67	1.76	3.20	≤26.60	3.4	6.6	≤24.00	PASS
11AX8 0MIMO	total	6145	---	---	---	---	6.77	≤26.60	6.41	13.18	≤24.00	PASS
11AX8 0MIMO	Ant1	6385	---	1.65	66.67	1.76	3.41	≤26.60	3.4	6.81	≤24.00	PASS
11AX8 0MIMO	Ant2	6385	---	0.95	66.67	1.76	2.71	≤26.60	3.4	6.11	≤24.00	PASS
11AX8 0MIMO	total	6385	---	---	---	---	6.08	≤26.60	6.41	12.49	≤24.00	PASS
11AX8 0MIMO	Ant1	6465	---	0.83	66.67	1.76	2.59	≤26.68	3.32	5.91	≤24.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX8 0MIMO	Ant2	6465	---	1.59	60.00	2.22	3.81	≤26.60	3.4	7.21	≤24.00	PASS
11AX8 0MIMO	total	6465	---	---	---	---	6.25	≤26.60	6.37	12.62	≤24.00	PASS
11AX8 0MIMO	Ant1	6545	---	1.43	66.67	1.76	3.19	≤26.60	3.4	6.59	≤24.00	PASS
11AX8 0MIMO	Ant2	6545	---	2.40	66.67	1.76	4.16	≤26.60	3.4	7.56	≤24.00	PASS
11AX8 0MIMO	total	6545	---	---	---	---	6.71	≤26.60	6.41	13.12	≤24.00	PASS
11AX8 0MIMO	Ant2	6705	---	1.60	66.67	1.76	3.36	≤26.60	3.4	6.76	≤24.00	PASS
11AX8 0MIMO	total	6705	---	---	---	---	6.70	≤26.60	6.41	13.11	≤24.00	PASS
11AX8 0MIMO	Ant1	6705	---	2.24	66.67	1.76	4.00	≤26.60	3.4	7.4	≤24.00	PASS
11AX8 0MIMO	Ant1	6865	---	2.11	66.67	1.76	3.87	≤26.60	3.4	7.27	≤24.00	PASS
11AX8 0MIMO	Ant2	6865	---	1.57	66.67	1.76	3.33	≤26.60	3.4	6.73	≤24.00	PASS
11AX8 0MIMO	total	6865	---	---	---	---	6.62	≤26.60	6.41	13.03	≤24.00	PASS
11AX8 0MIMO	Ant1	6945	---	1.91	66.67	1.76	3.67	≤26.60	3.4	7.07	≤24.00	PASS
11AX8 0MIMO	Ant2	6945	---	2.28	66.67	1.76	4.04	≤26.60	3.4	7.44	≤24.00	PASS
11AX8 0MIMO	total	6945	---	---	---	---	6.87	≤26.60	6.41	13.28	≤24.00	PASS
11AX8 0MIMO	Ant1	7025	---	1.87	66.67	1.76	3.63	≤26.60	3.4	7.03	≤24.00	PASS
11AX8 0MIMO	Ant2	7025	---	2.24	60.00	2.22	4.46	≤26.60	3.4	7.86	≤24.00	PASS
11AX8 0MIMO	total	7025	---	---	---	---	7.08	≤26.60	6.41	13.49	≤24.00	PASS

Note: 1. The Duty Cycle Factor is compensated in the graph.

2. For Wi-Fi UNII5, Wi-Fi UNII7 and Wi-Fi UNII8, Directional gain = $10 \log[(10^{G1/20} + 10^{G2/20})^2 / N_{ANT}]$ dBi= $10 \log[(10^{3.4/20} + 10^{3.4/20})^2 / 2]$ dBi= 6.41dBi.

For Wi-Fi UNII6, As Directional gain = $10 \log[(10^{G1/20} + 10^{G2/20})^2 / N_{ANT}]$ dBi= $10 \log[(10^{3.32/20} + 10^{3.4/20})^2 / 2]$ dBi= 6.37dBi.


3. MIMO= $10 * \log((10^{ANT1/10}) + 10^{(ANT2/10)})$

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

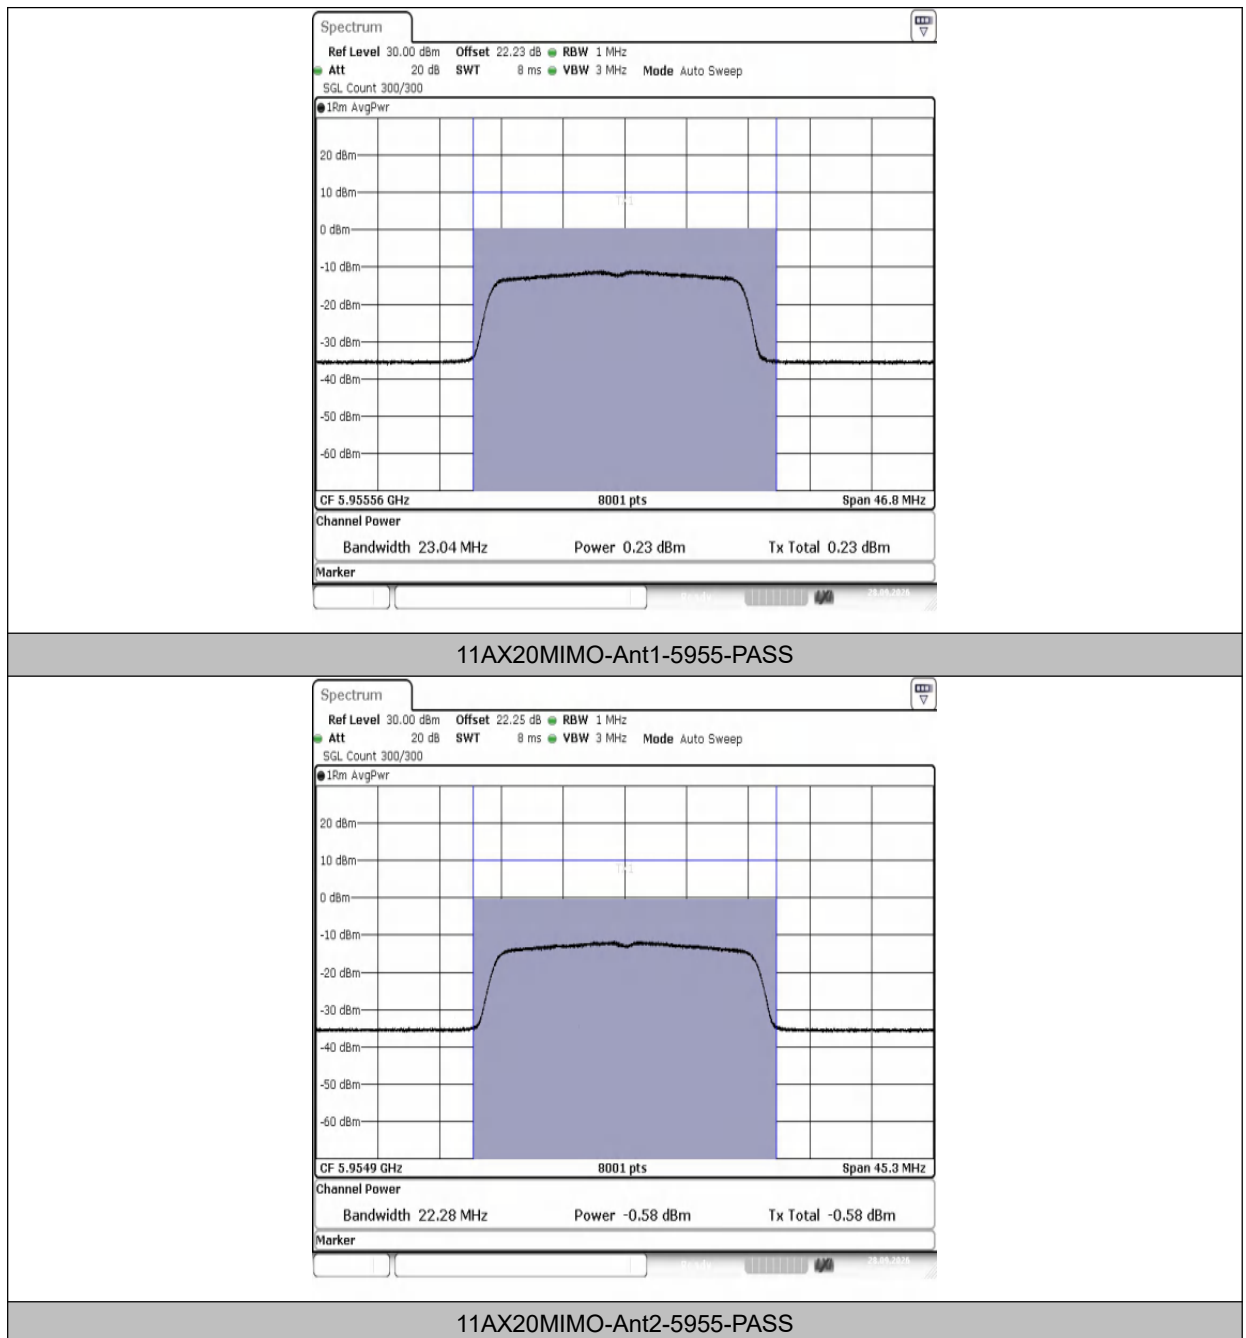

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

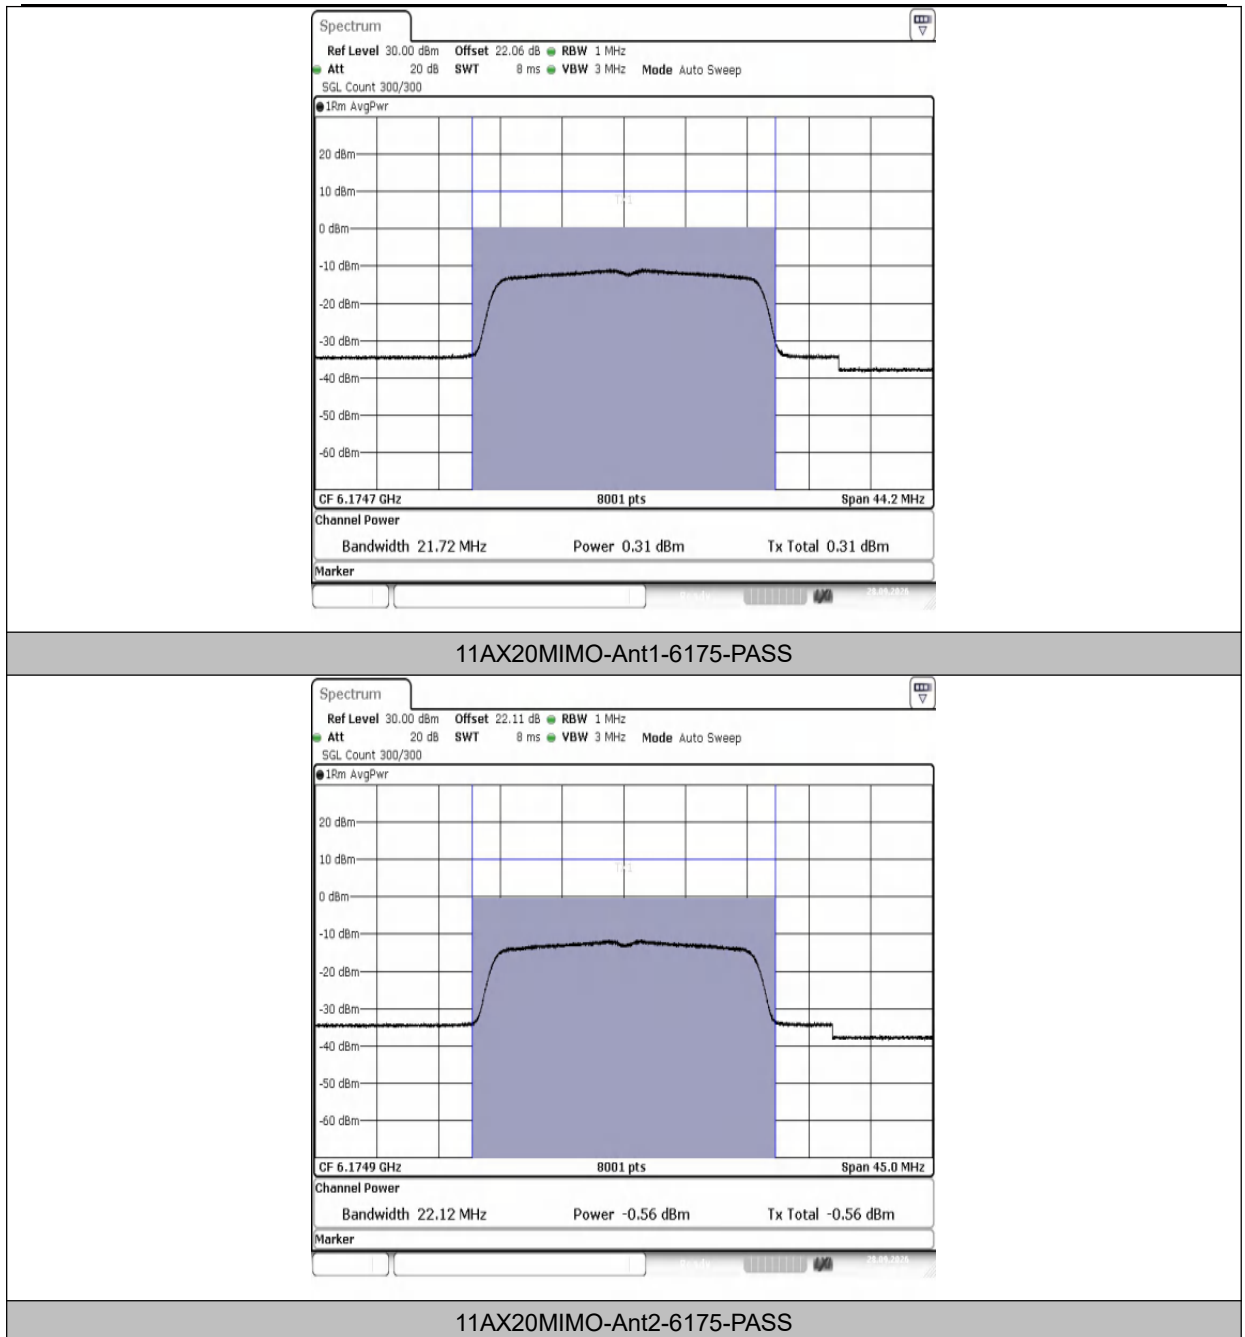

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

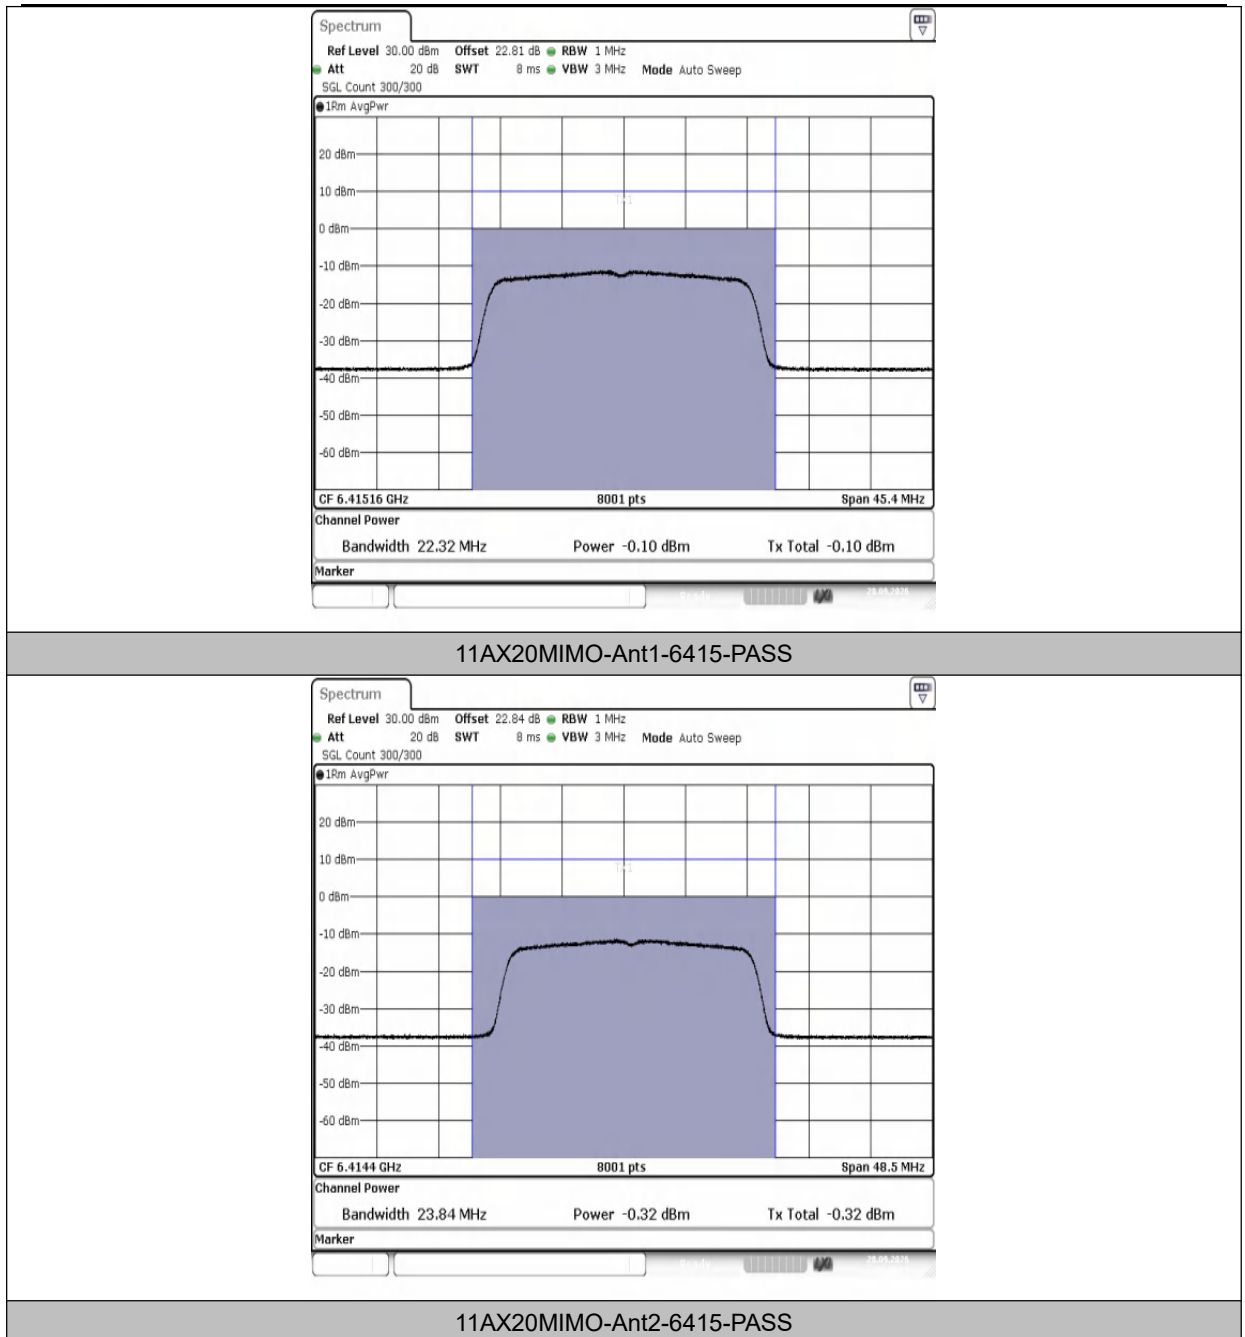


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

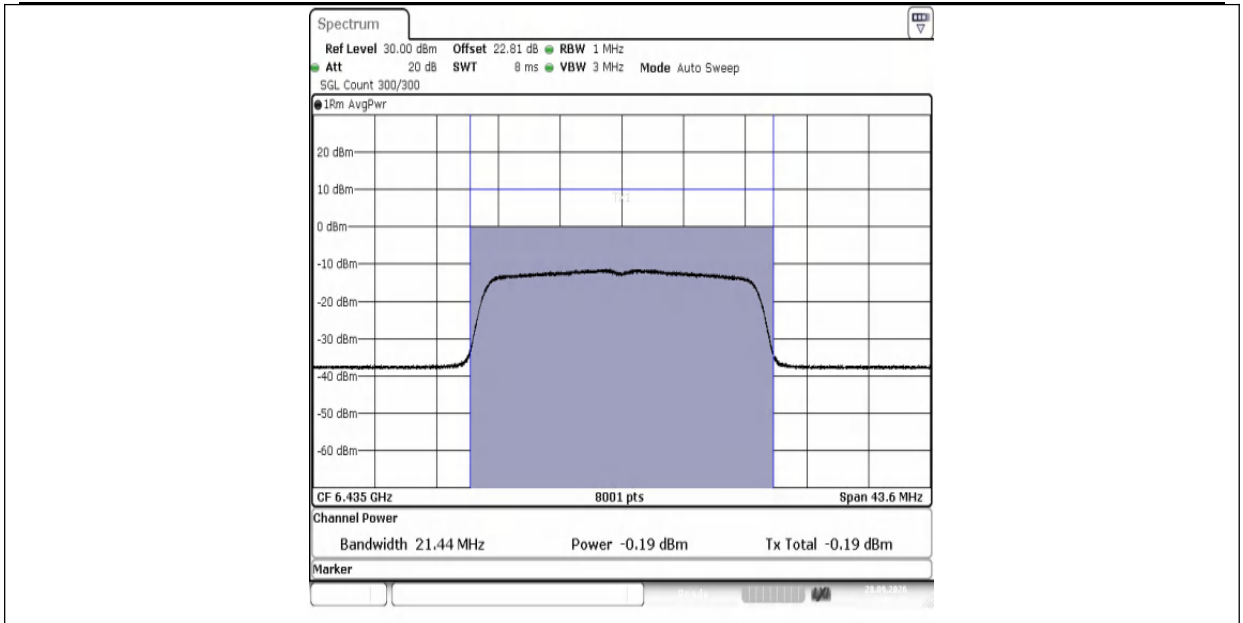

11AX20MIMO-Ant1-6435-PASS

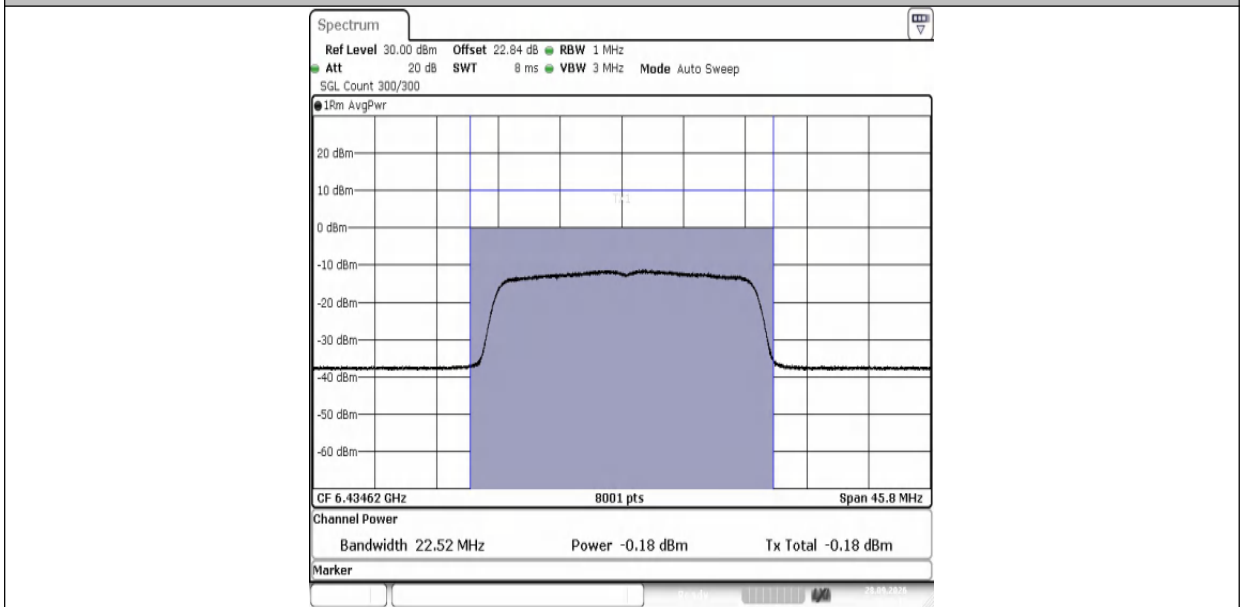


11AX20MIMO-Ant2-6435-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

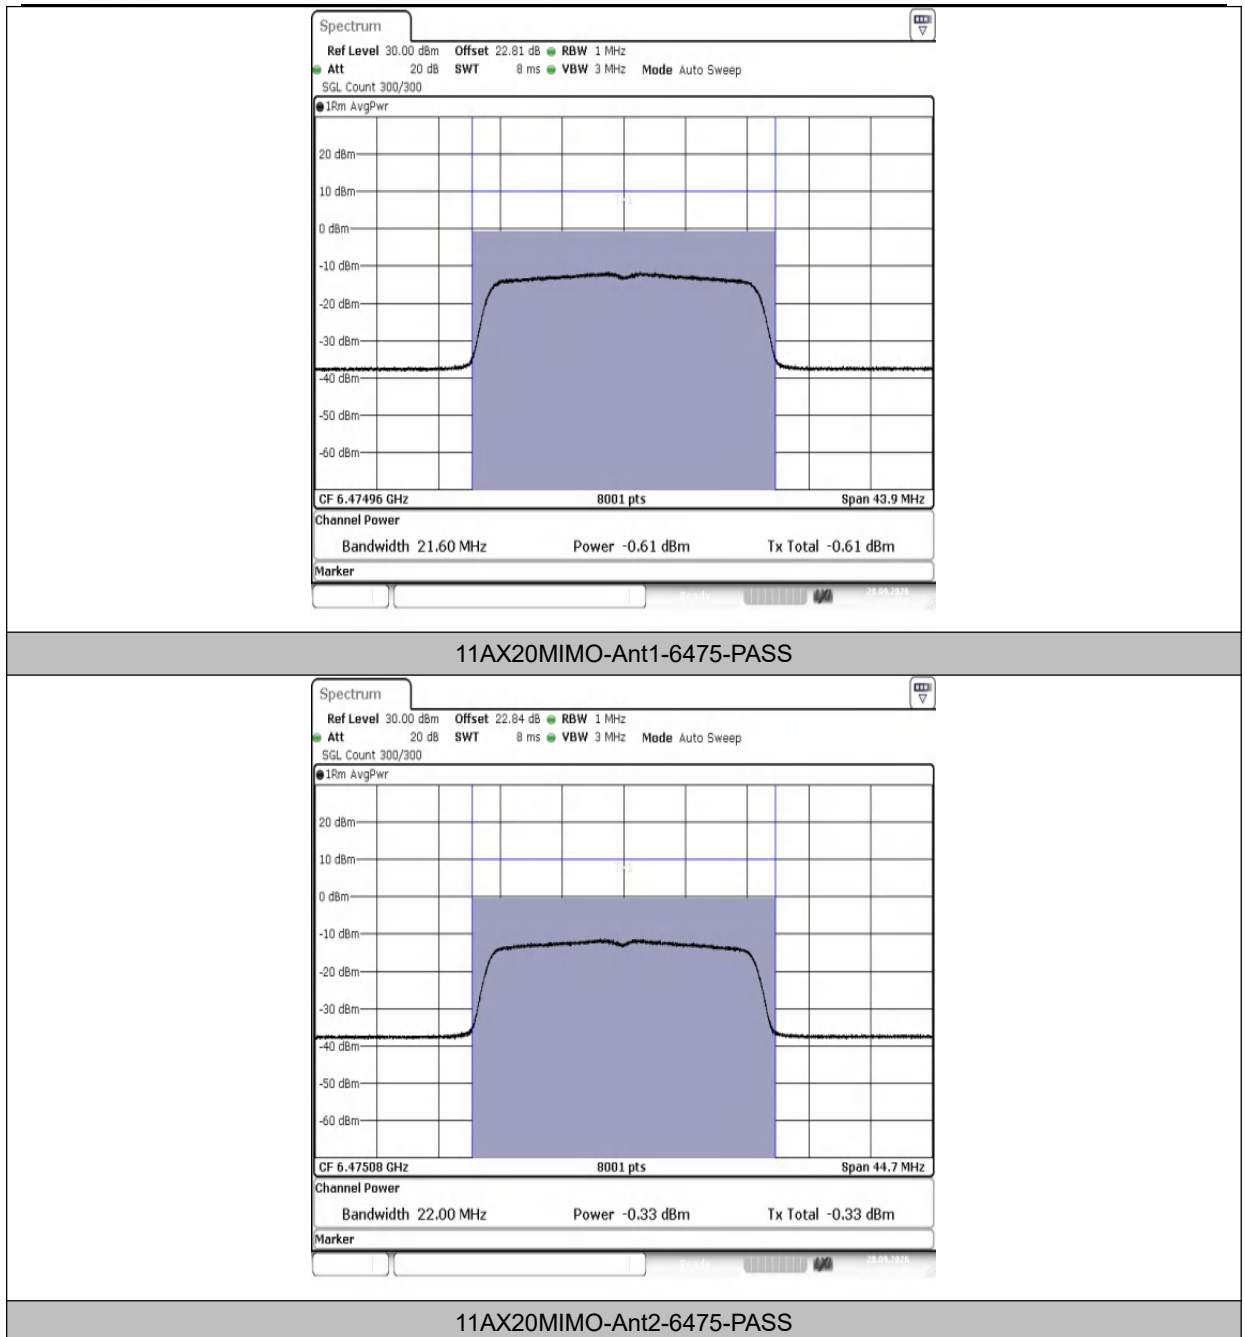


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

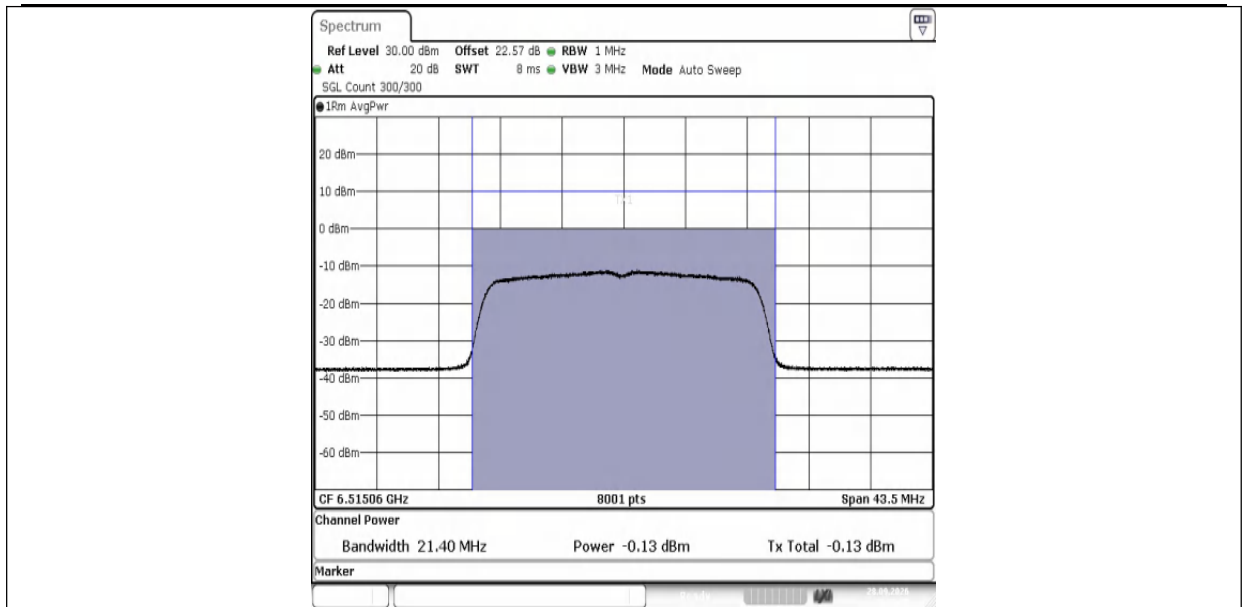


11AX20MIMO-Ant2-6515-PASS

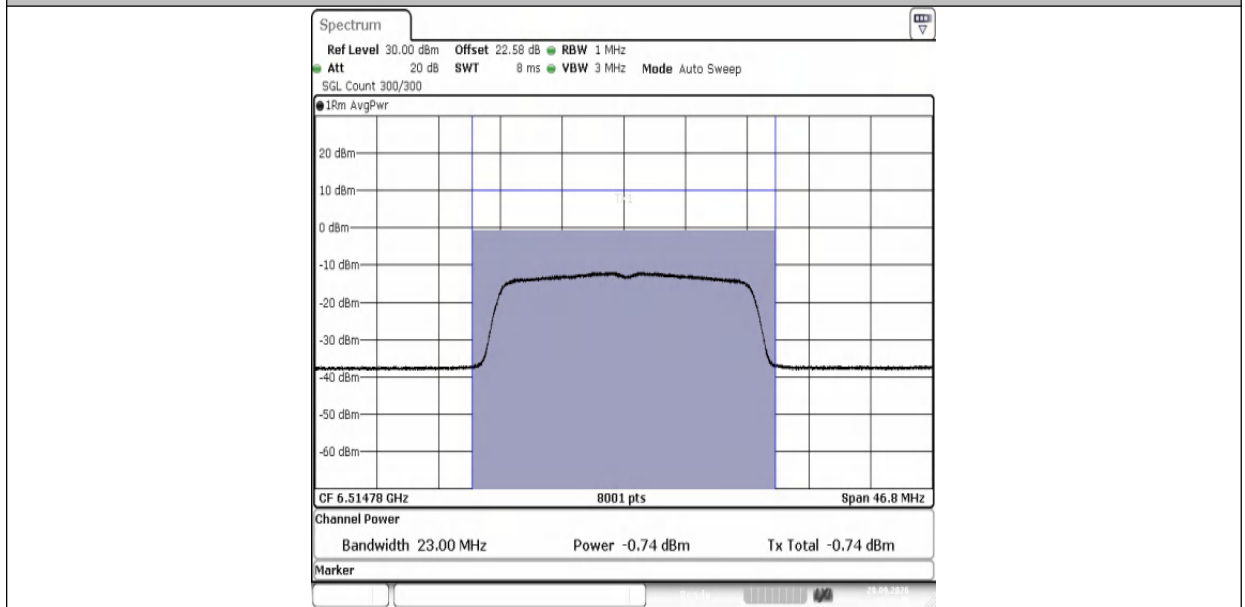

11AX20MIMO-Ant1-6515-PASS

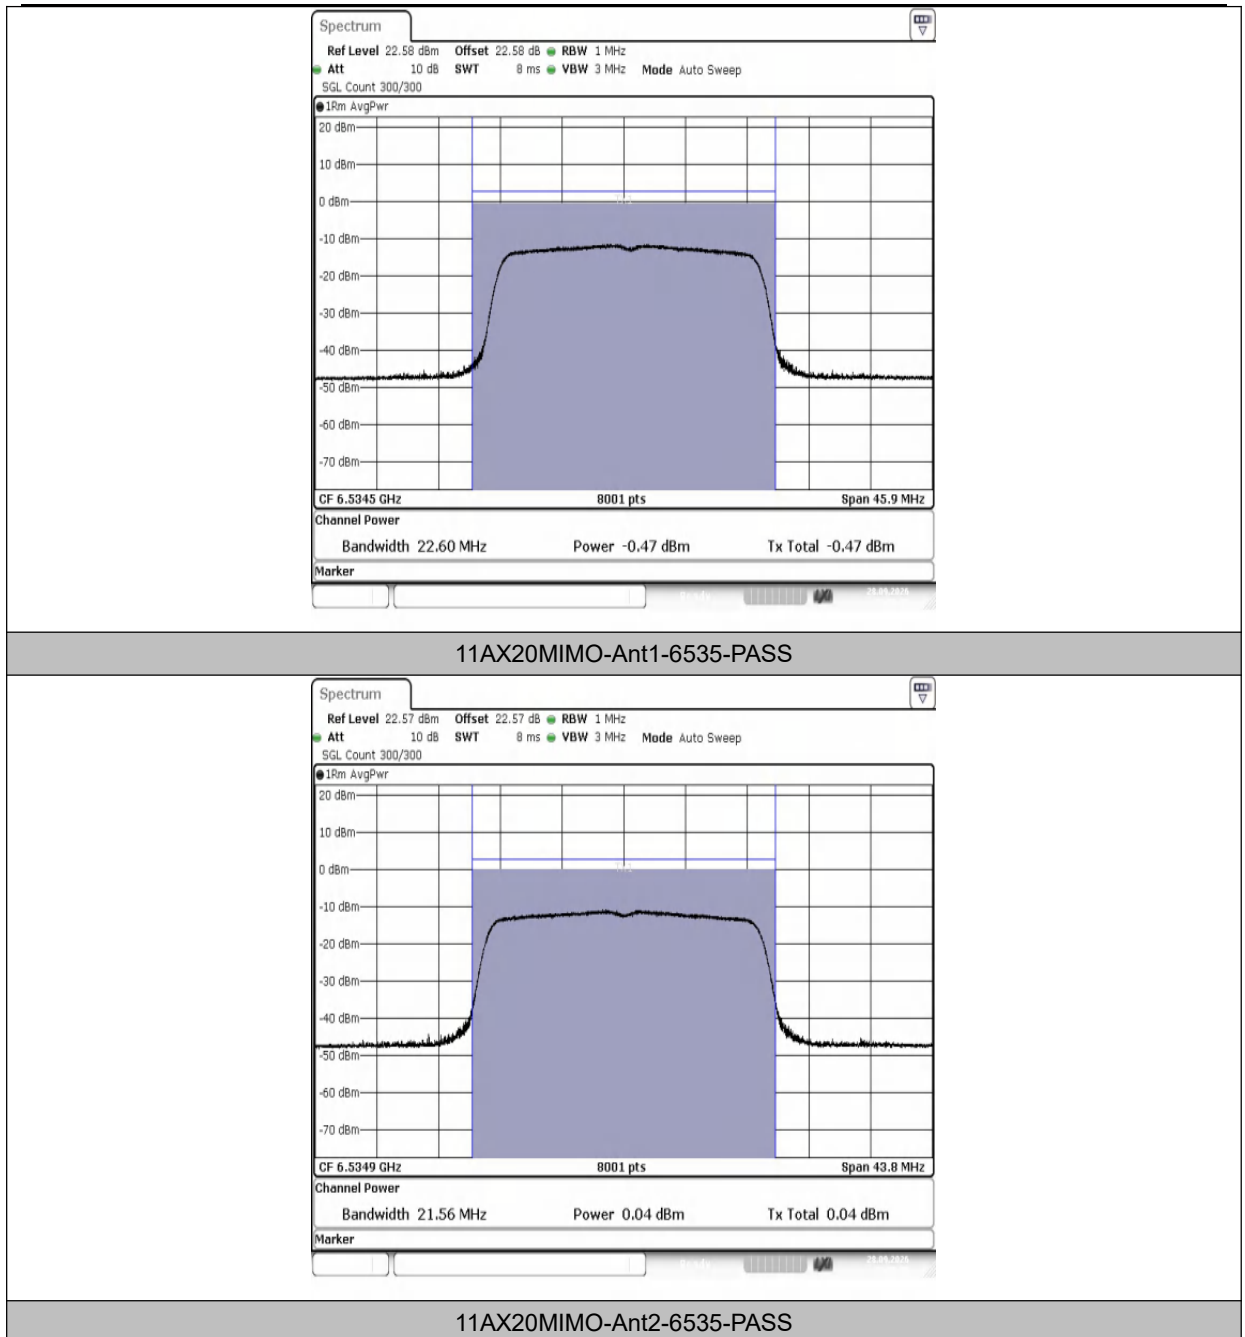


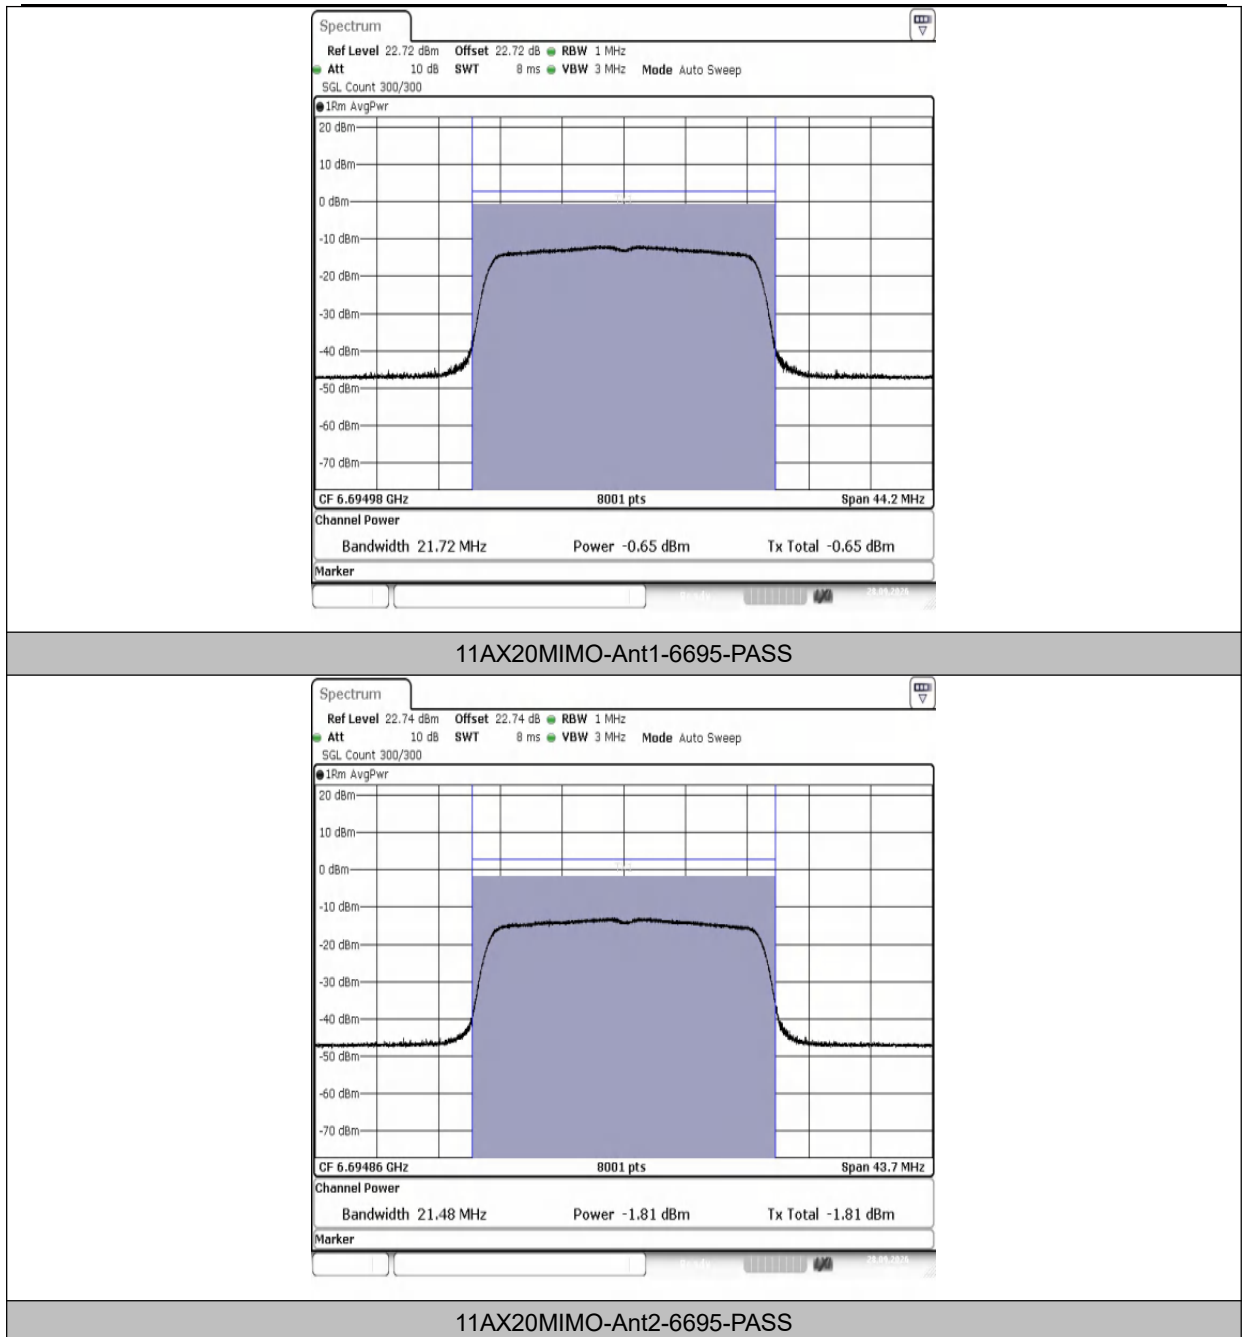

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

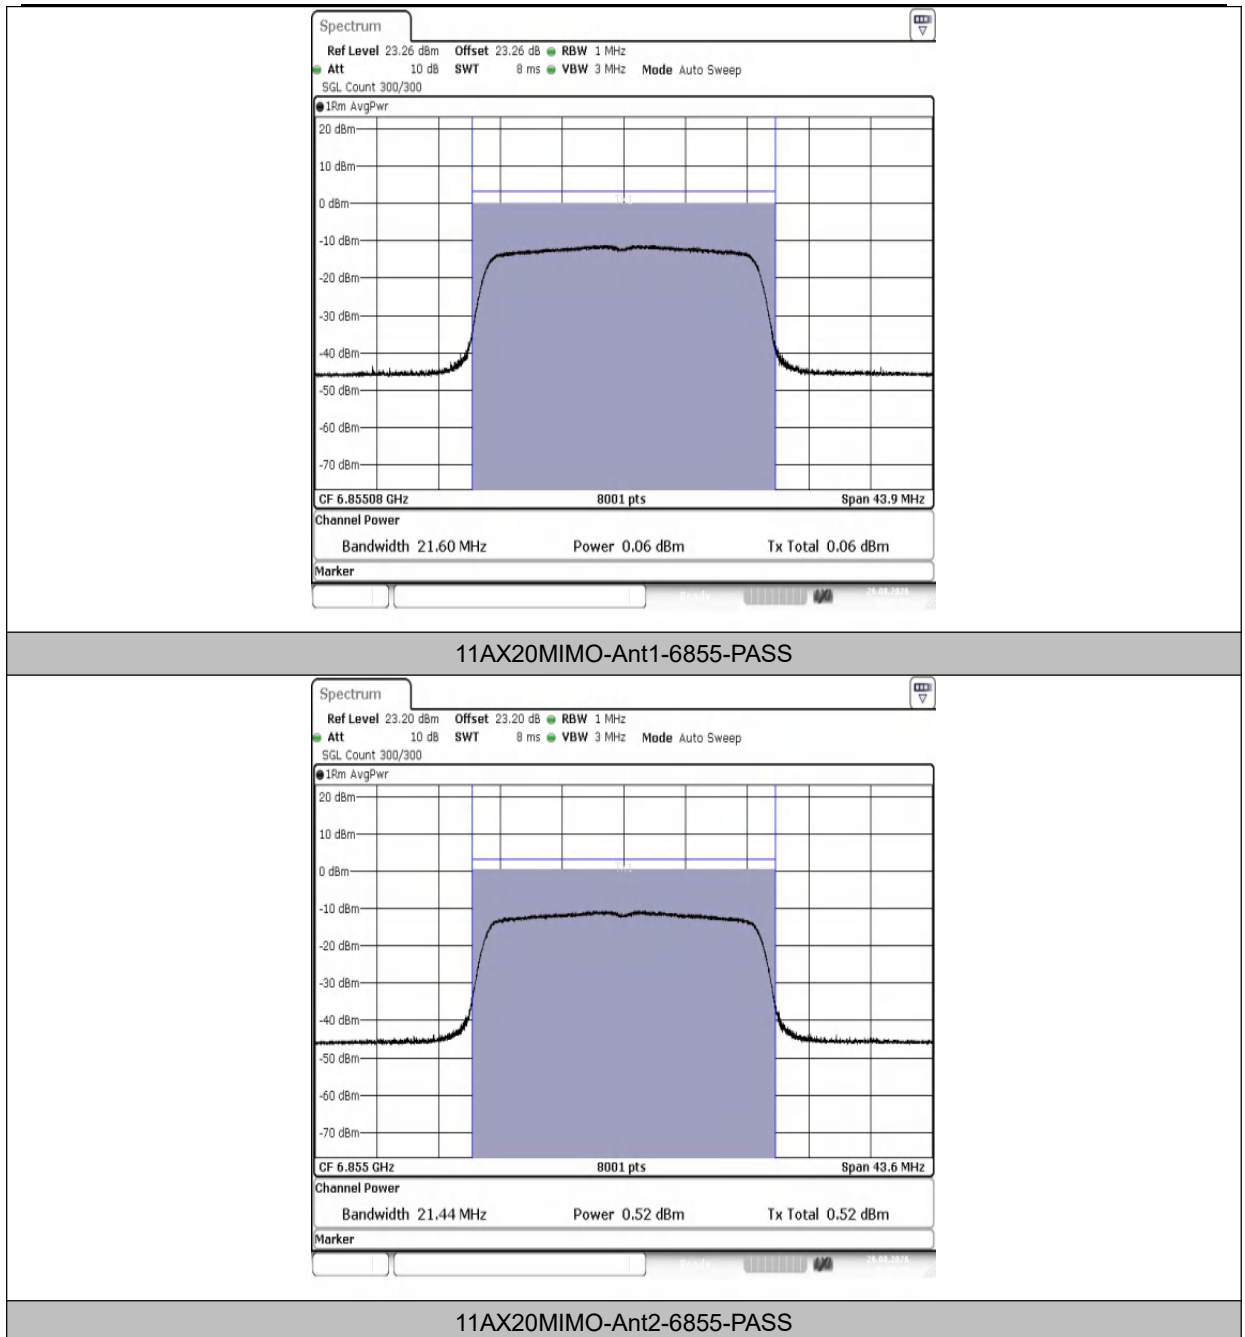

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

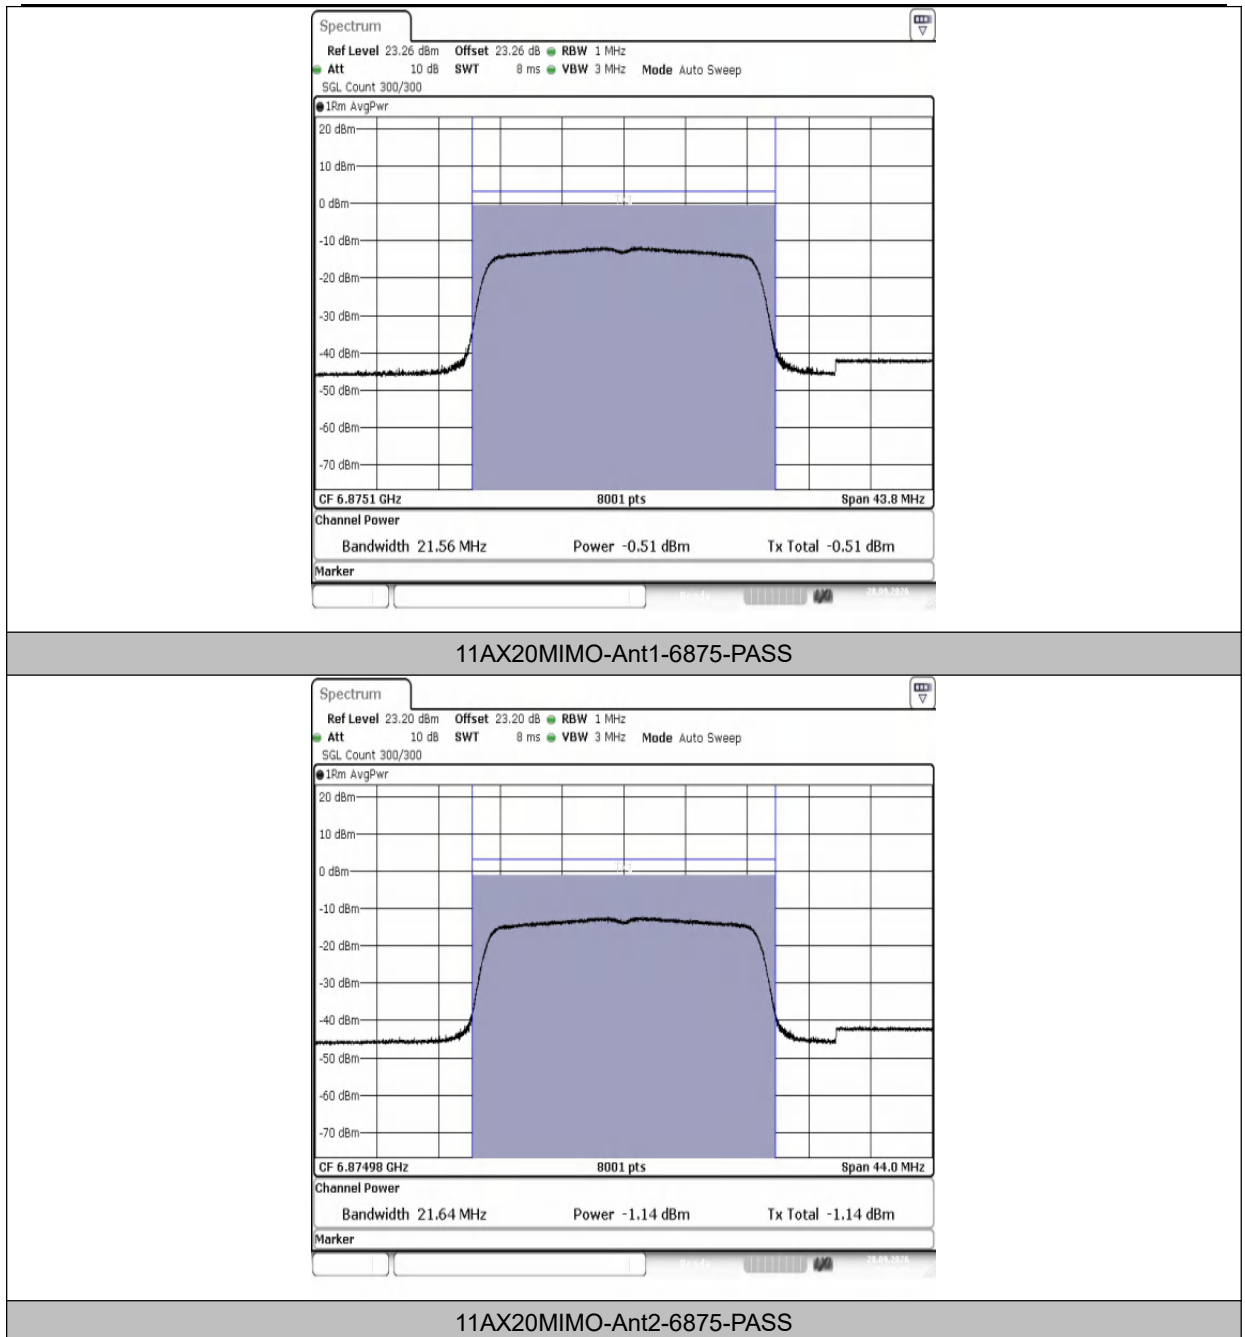


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

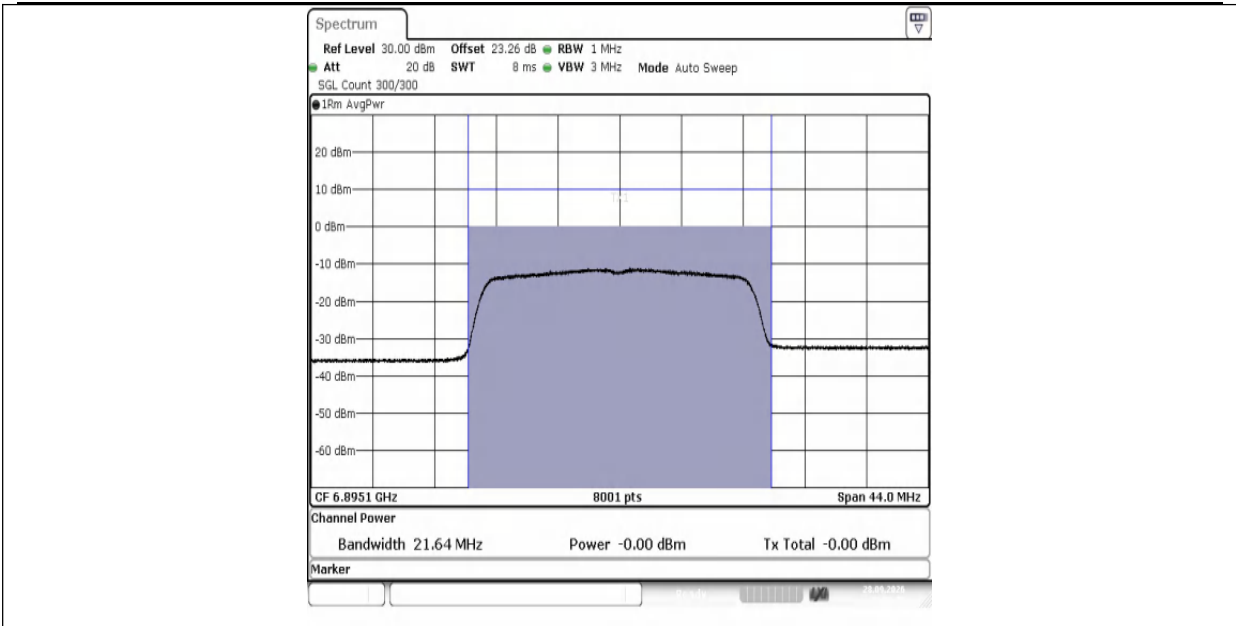

11AX20MIMO-Ant1-6895-PASS

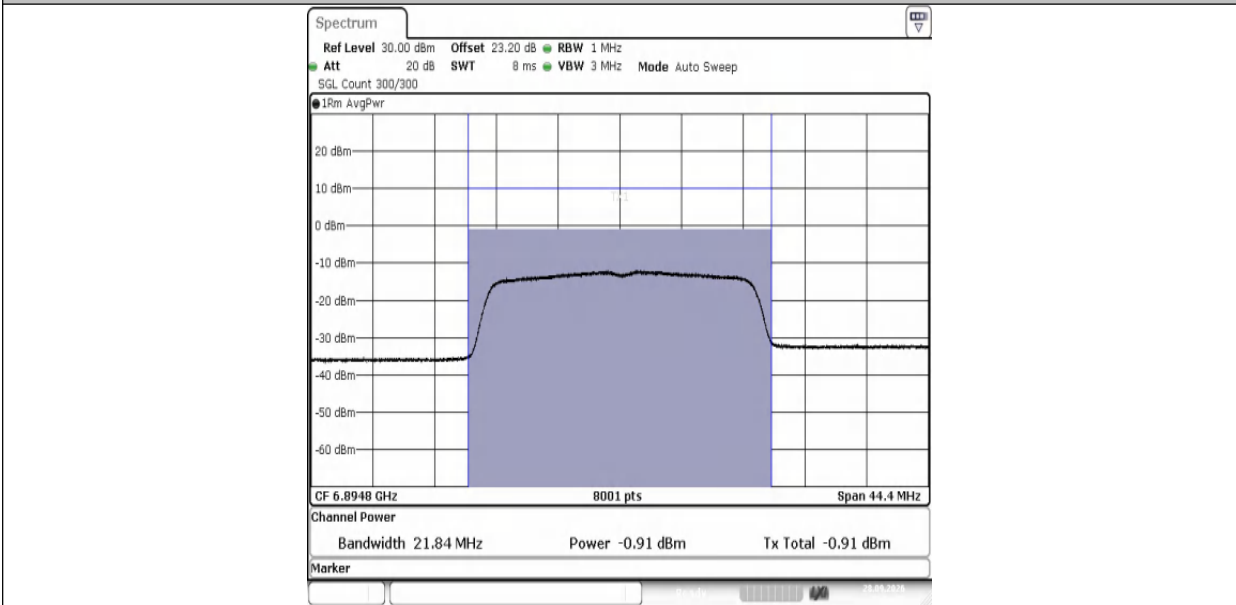


11AX20MIMO-Ant2-6895-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

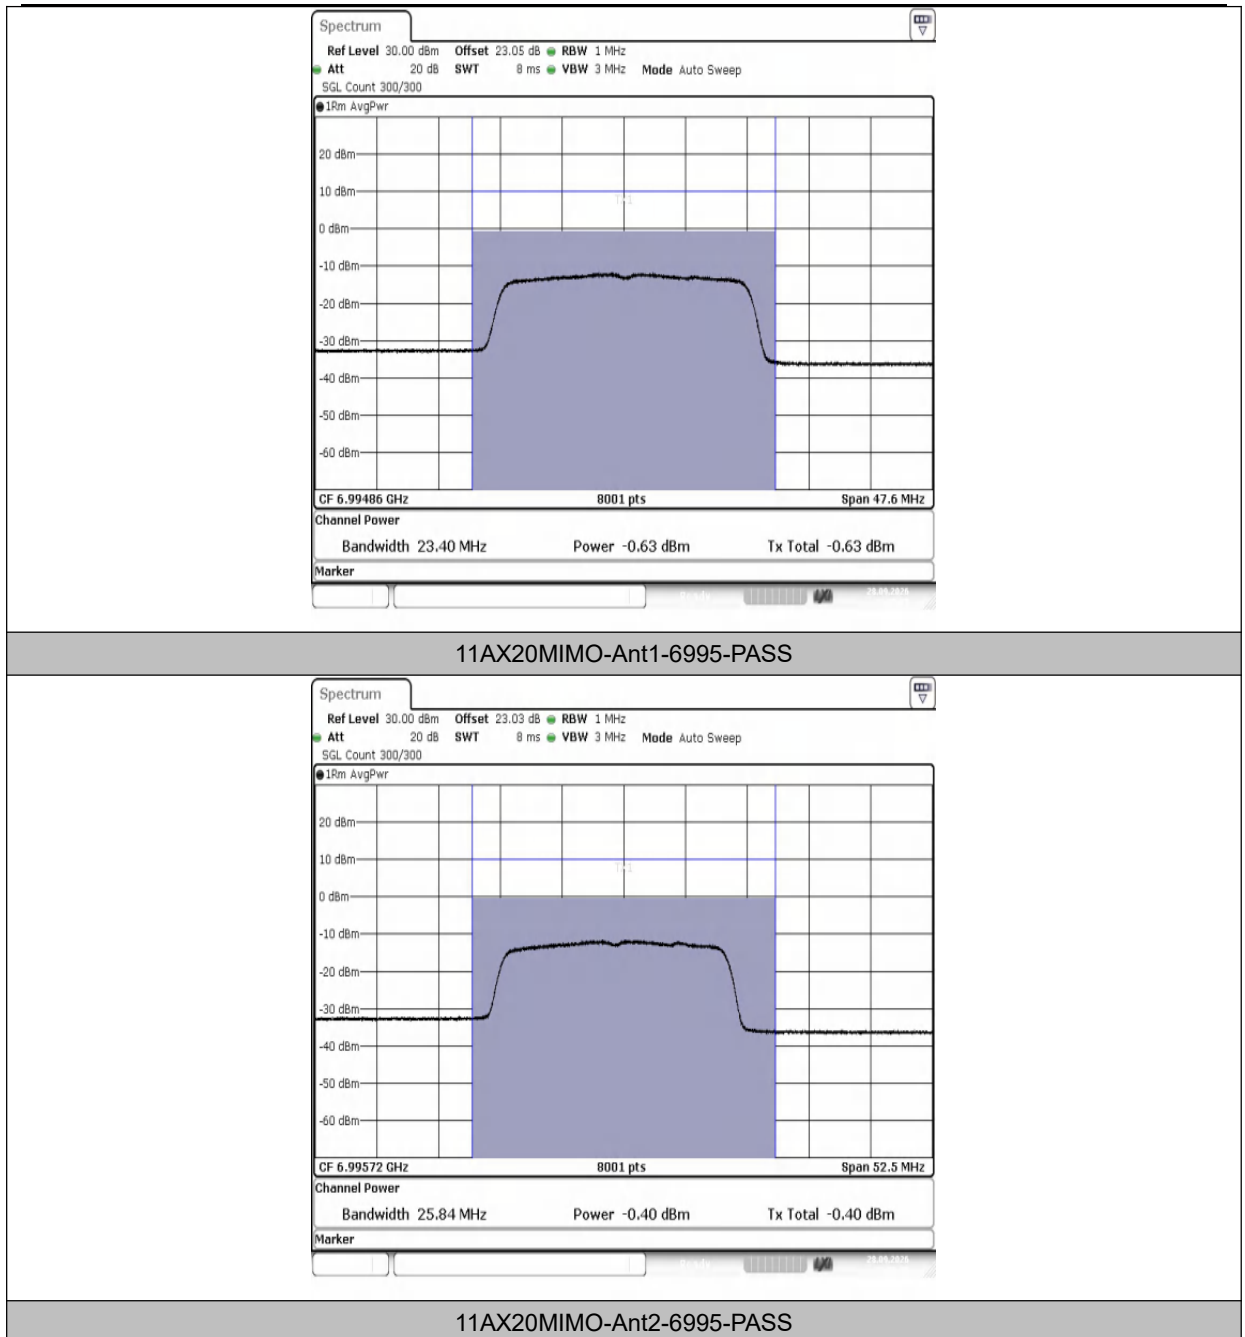


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

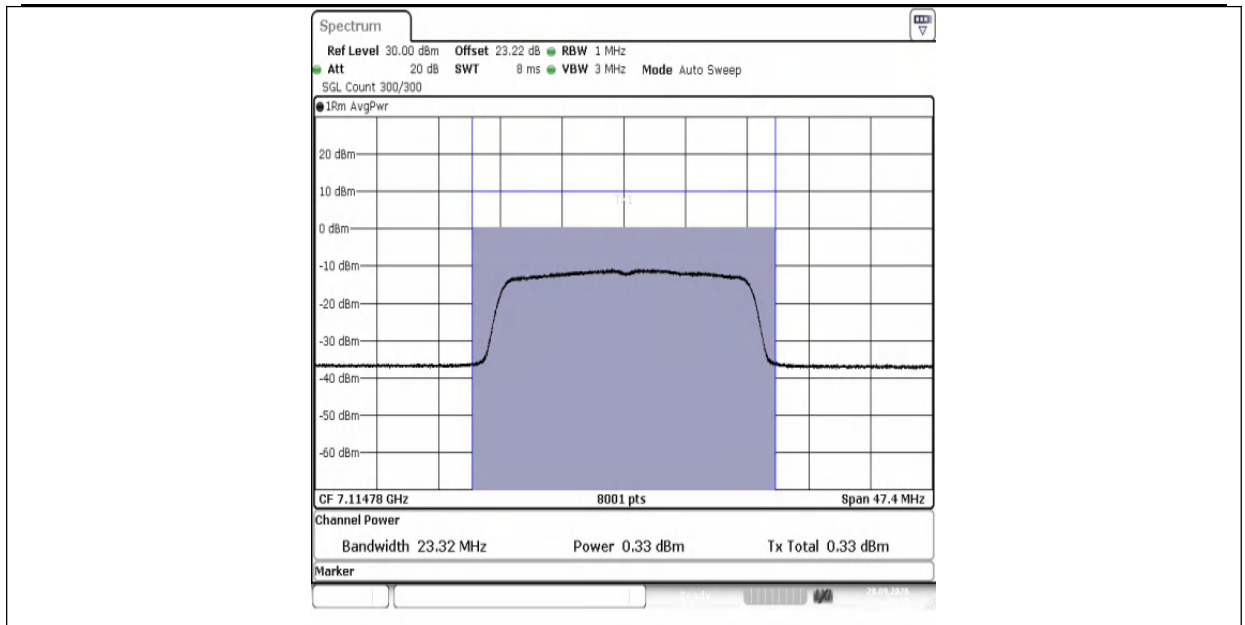

11AX20MIMO-Ant1-7115-PASS

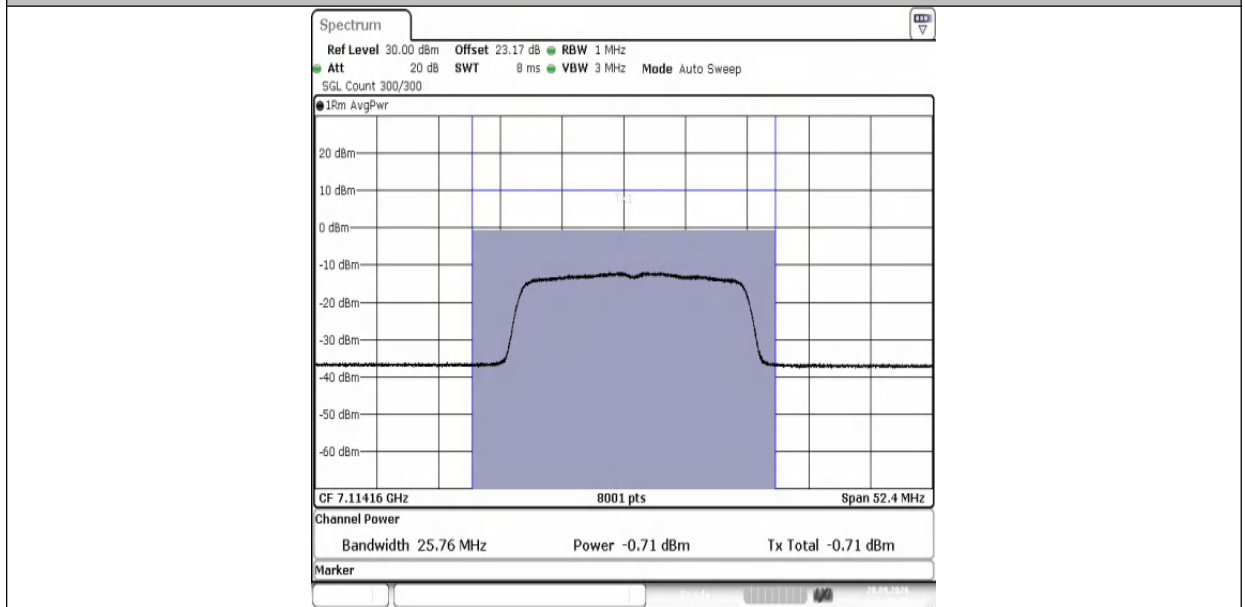


11AX20MIMO-Ant2-7115-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

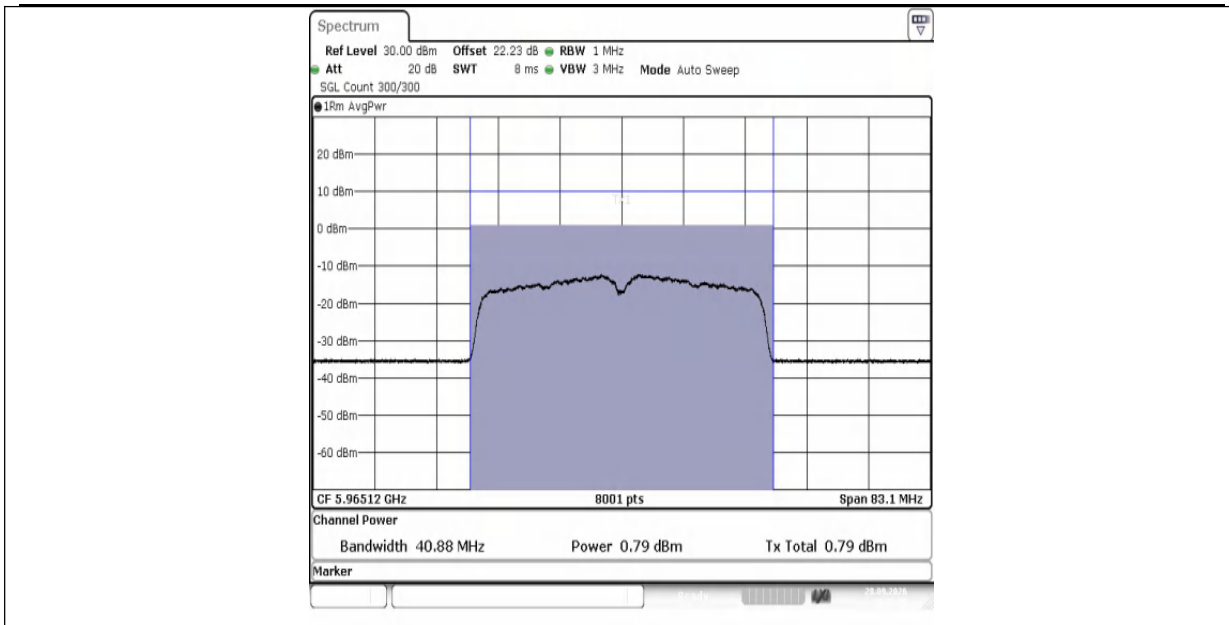

11AX40MIMO-Ant1-5965-PASS

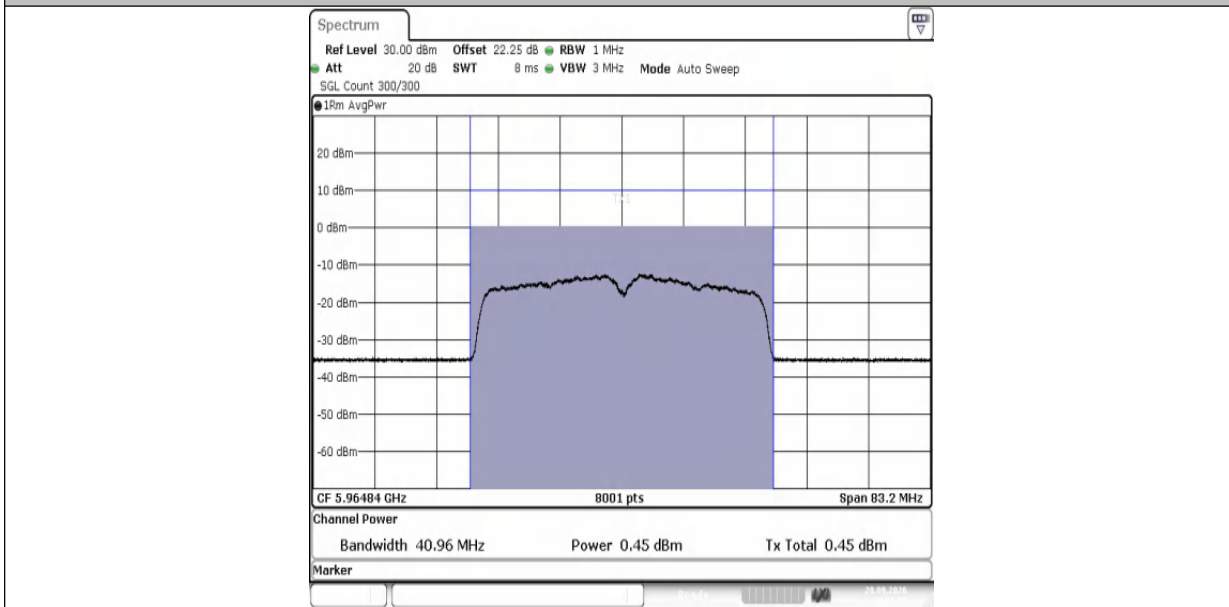


11AX40MIMO-Ant2-5965-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

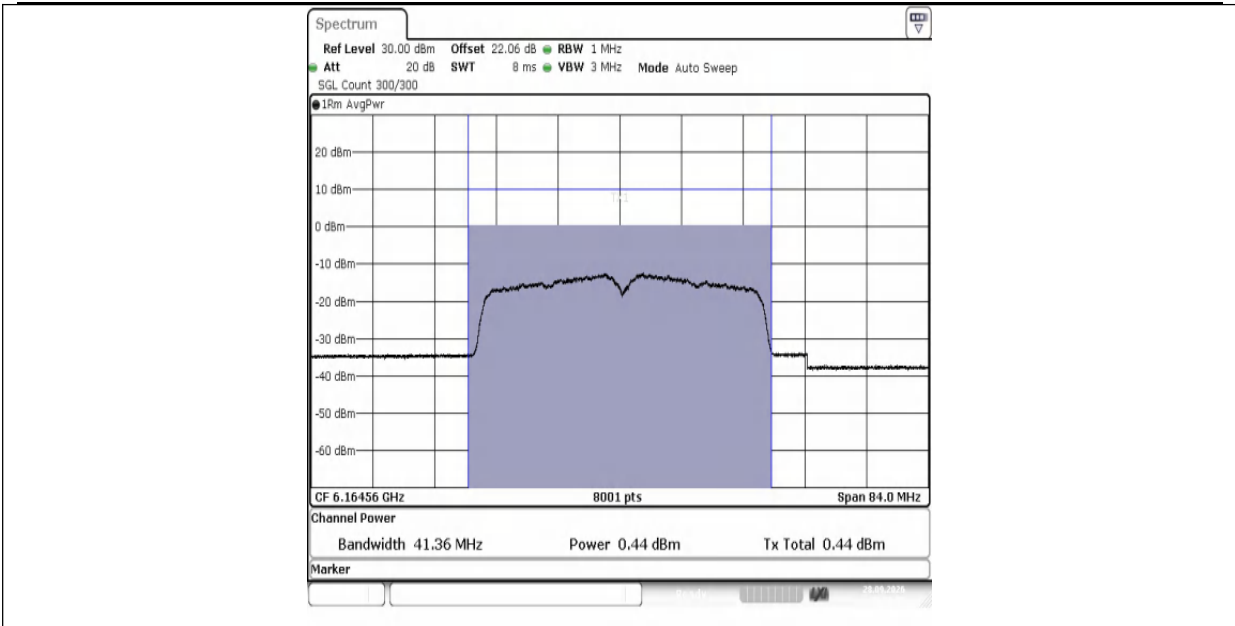

11AX40MIMO-Ant1-6165-PASS

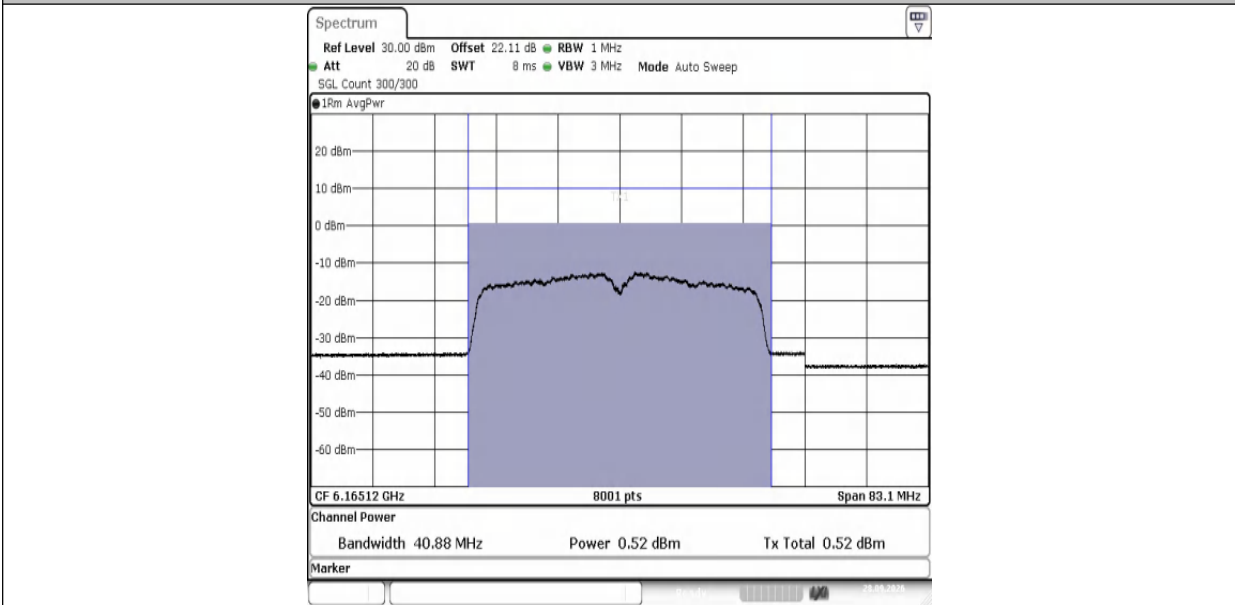


11AX40MIMO-Ant2-6165-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

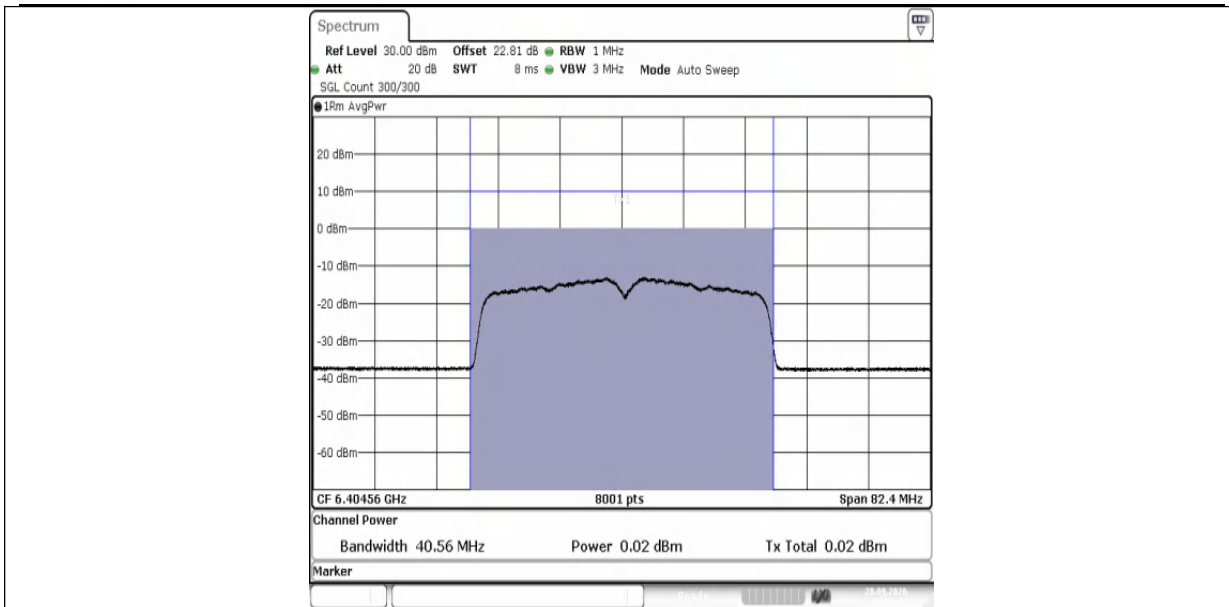

11AX40MIMO-Ant1-6405-PASS

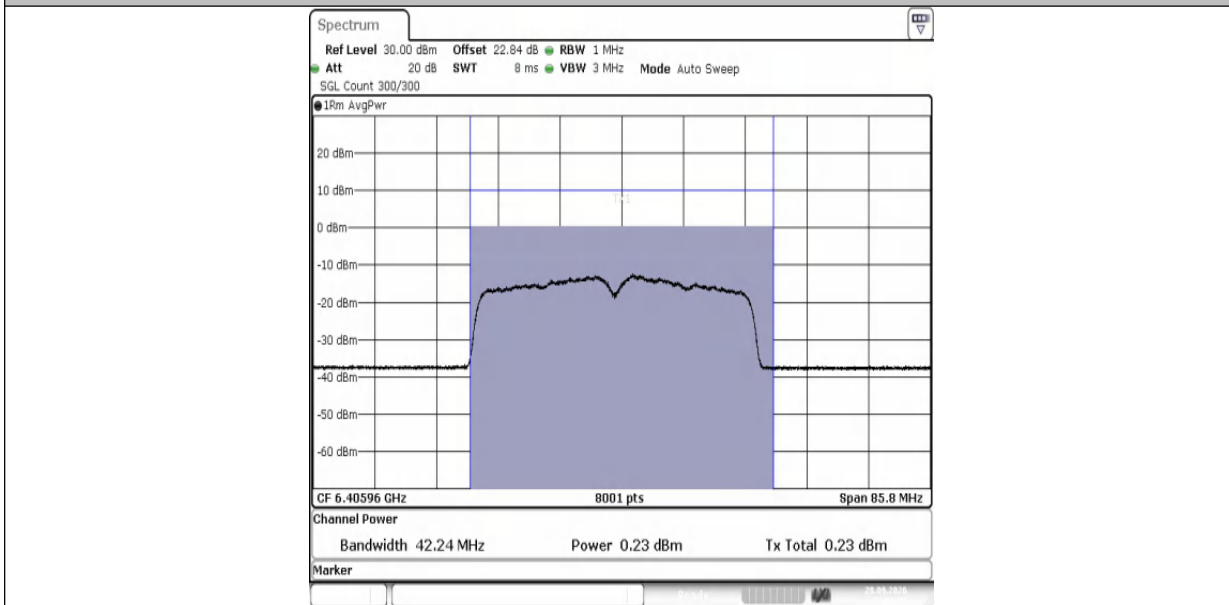


11AX40MIMO-Ant2-6405-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

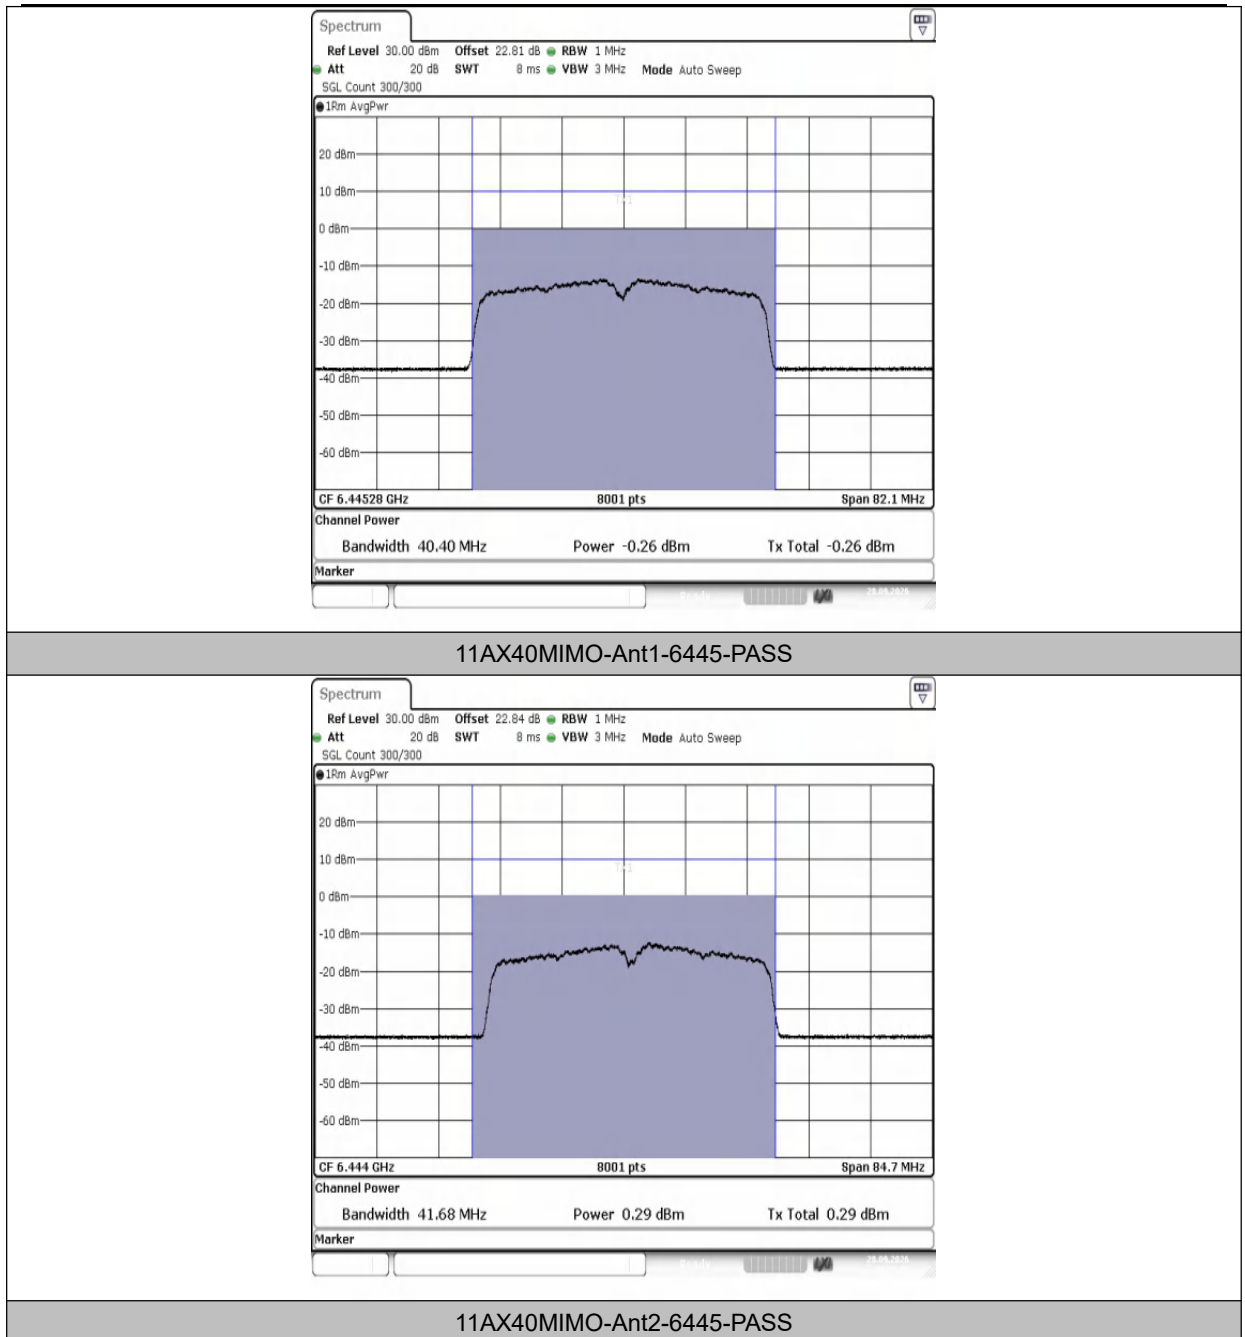

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

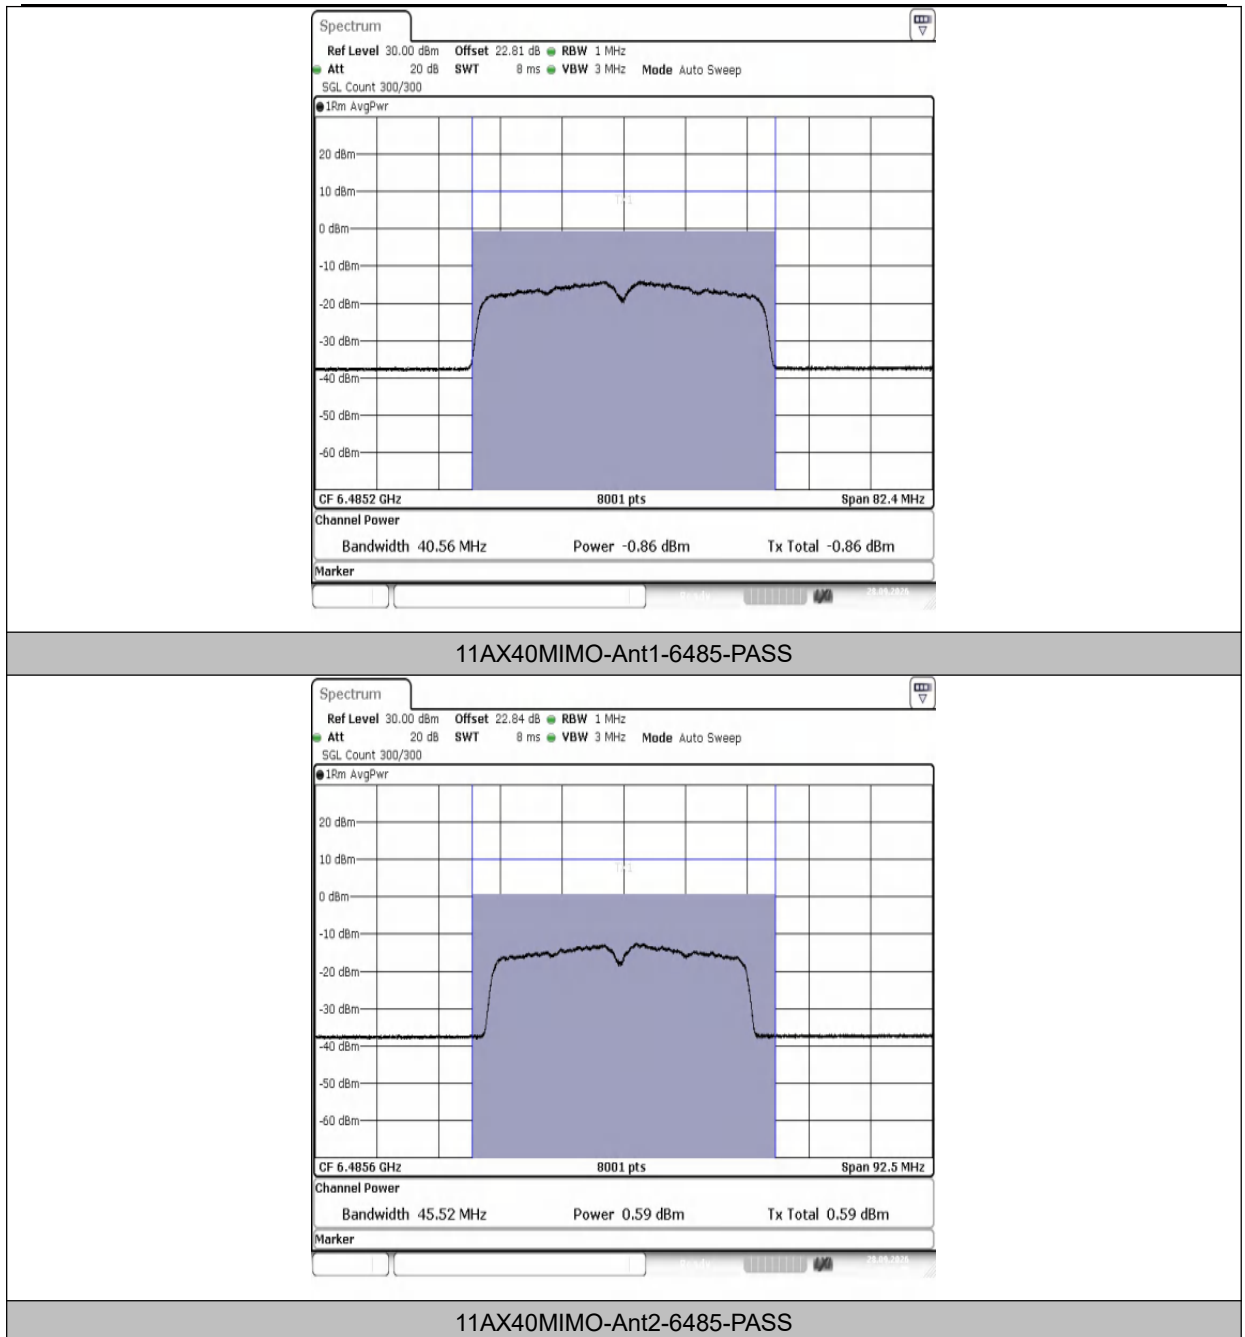

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

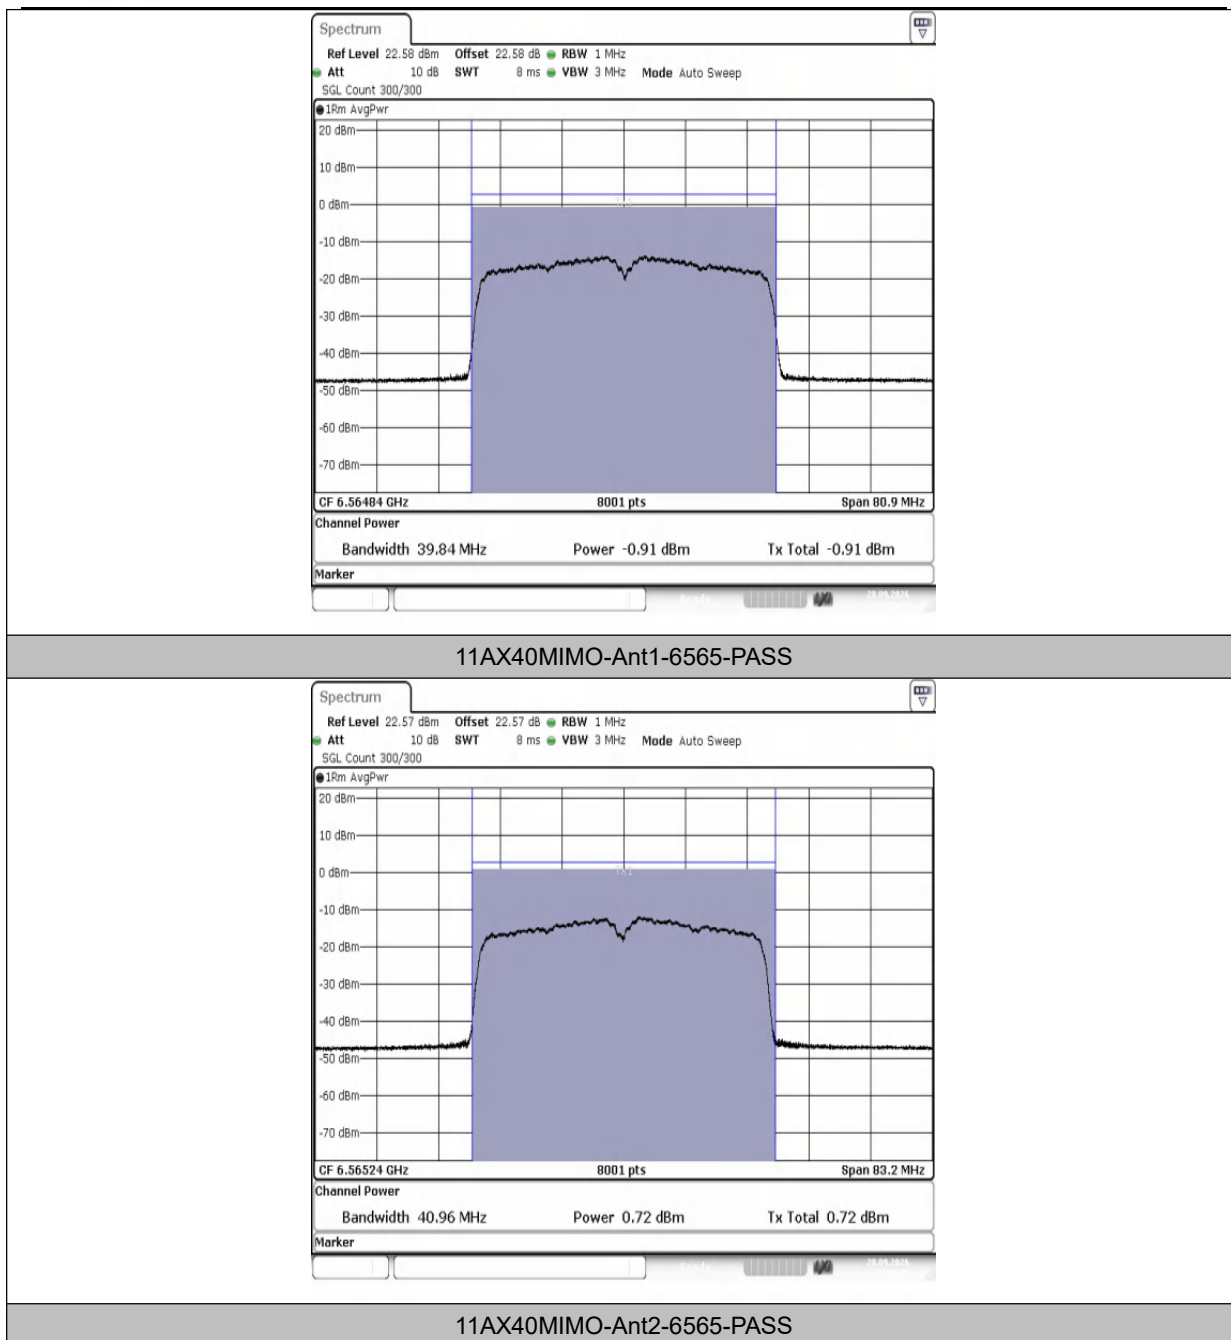


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

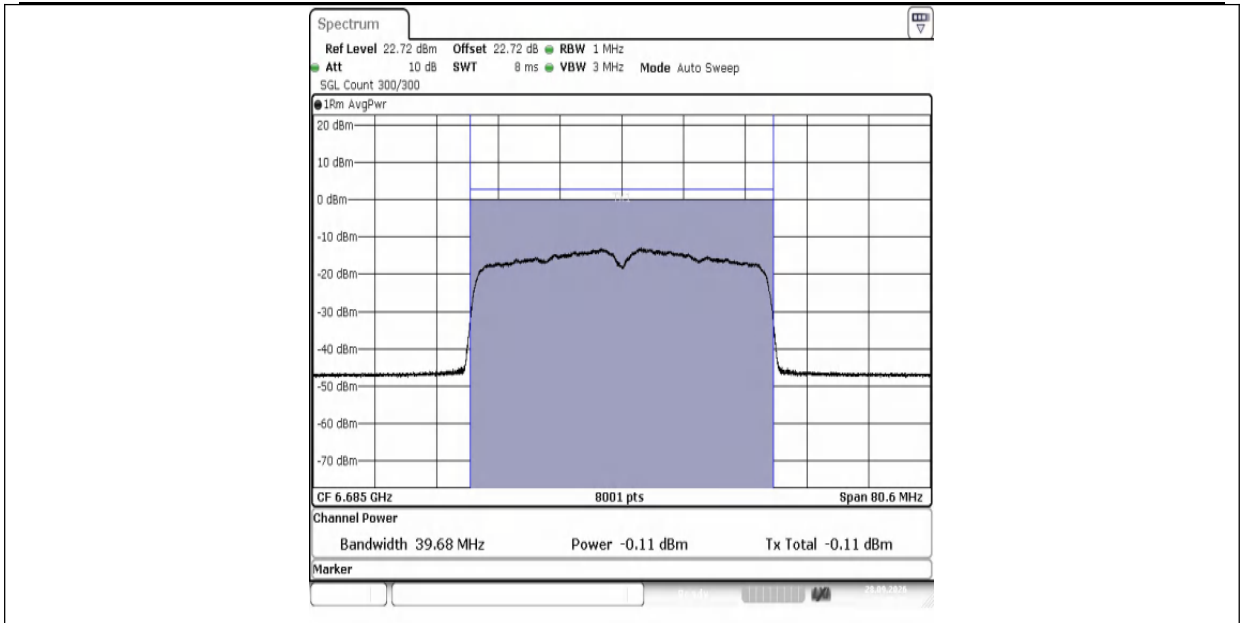

11AX40MIMO-Ant1-6685-PASS

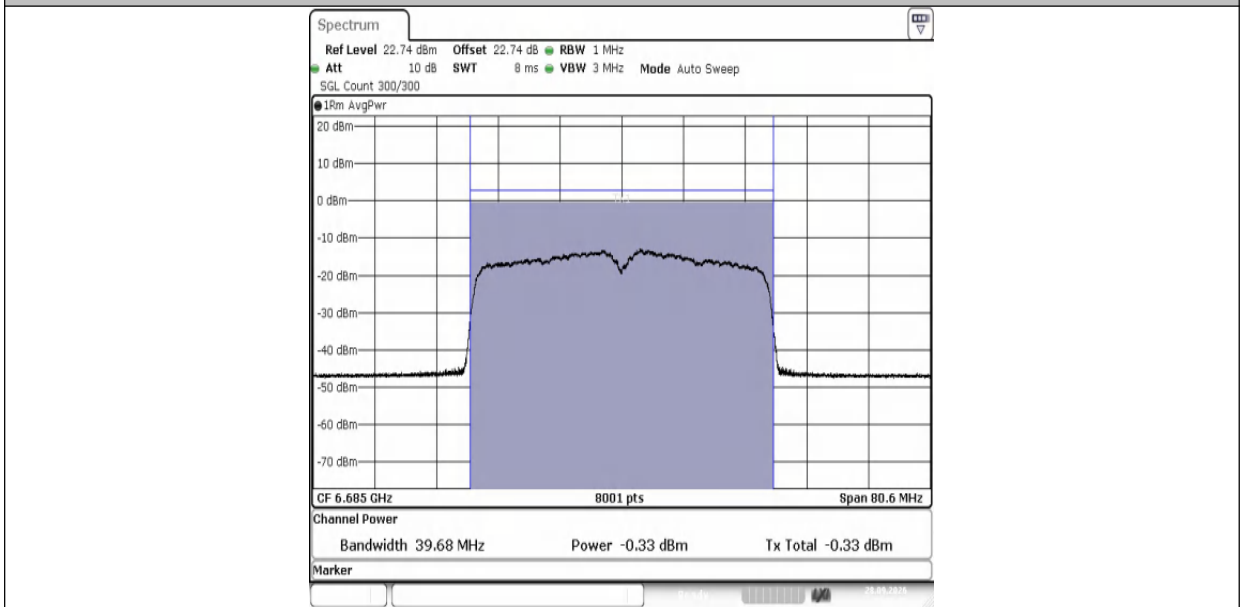


11AX40MIMO-Ant2-6685-PASS

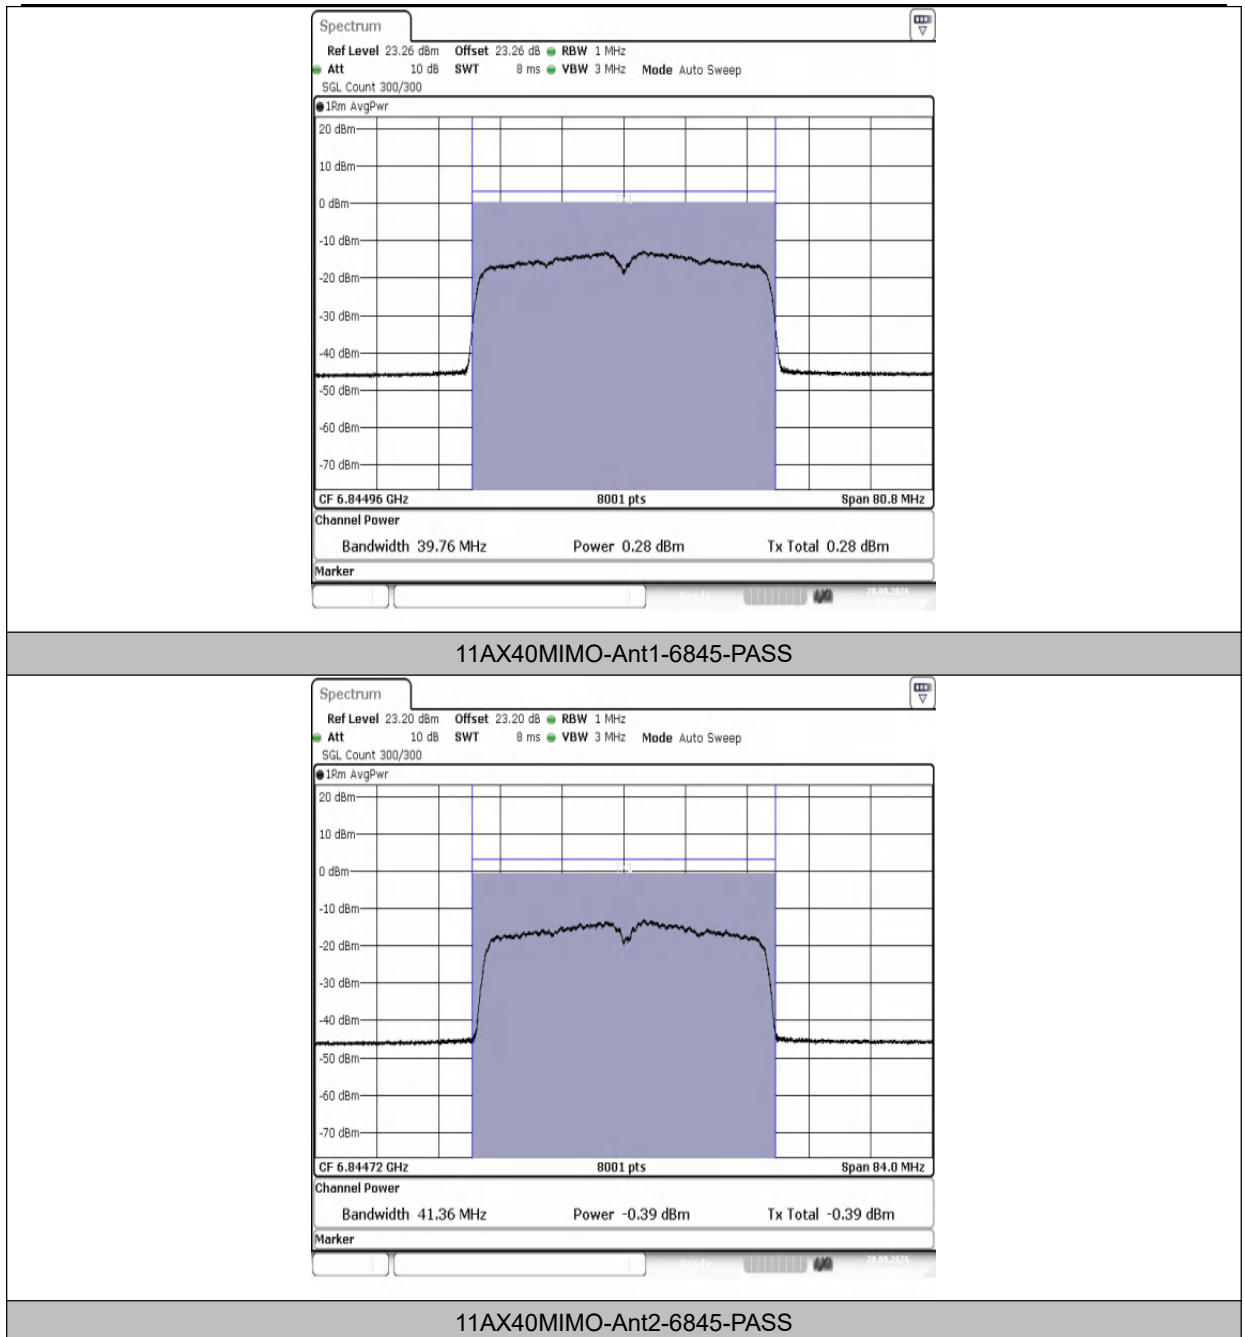


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

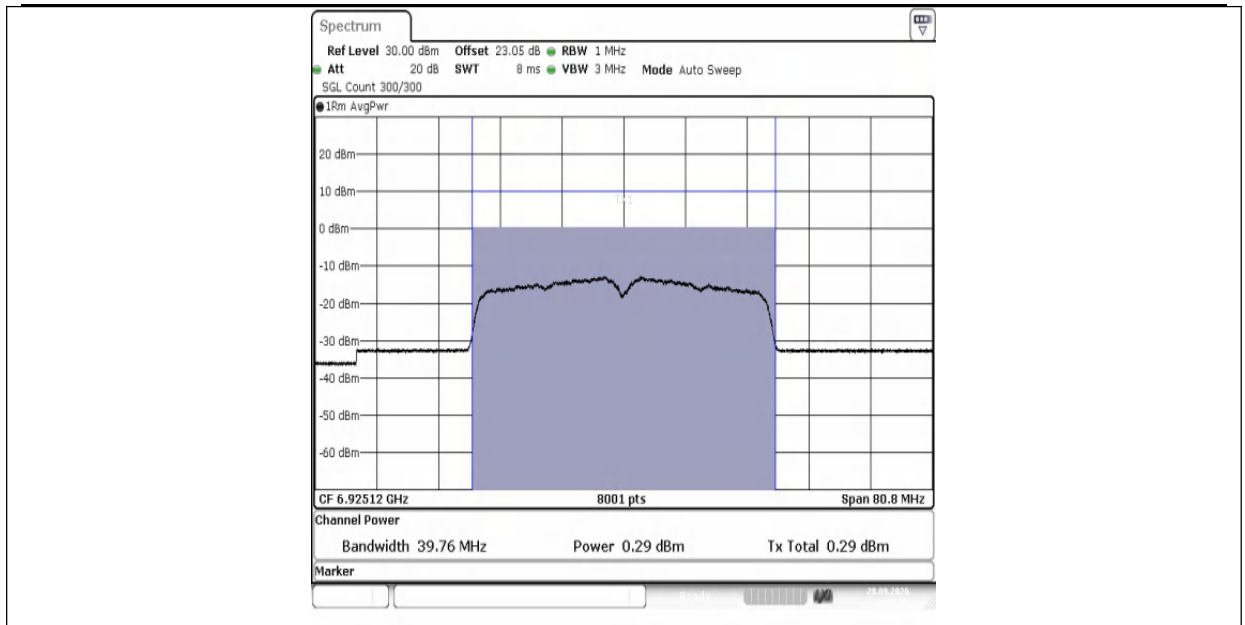

11AX40MIMO-Ant1-6925-PASS

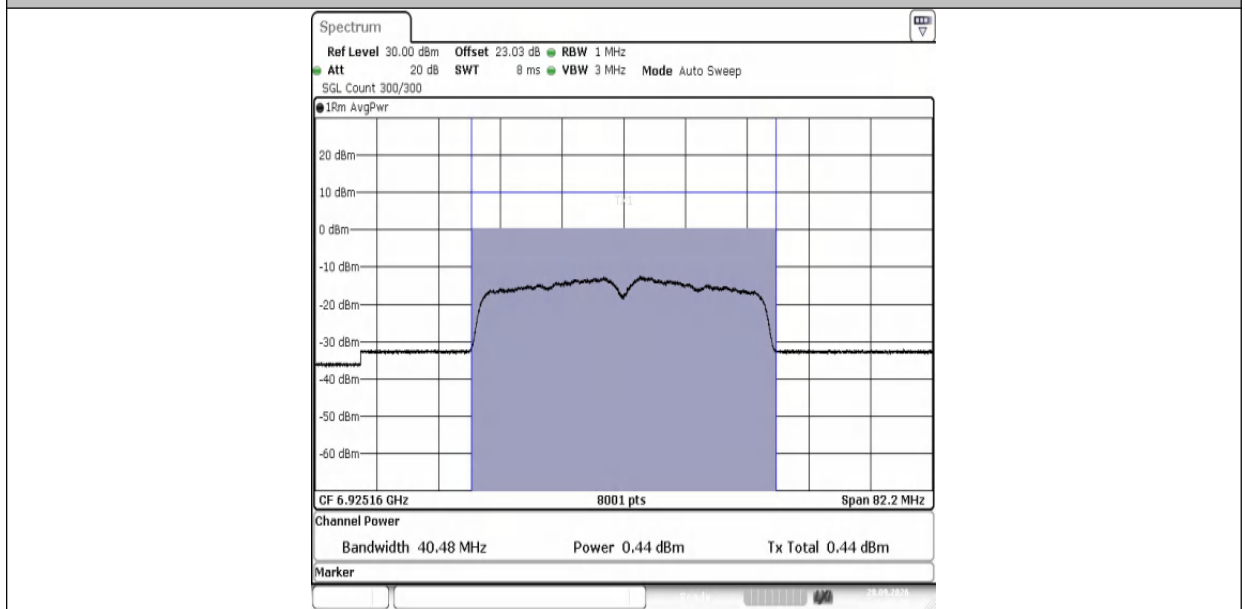


11AX40MIMO-Ant2-6925-PASS

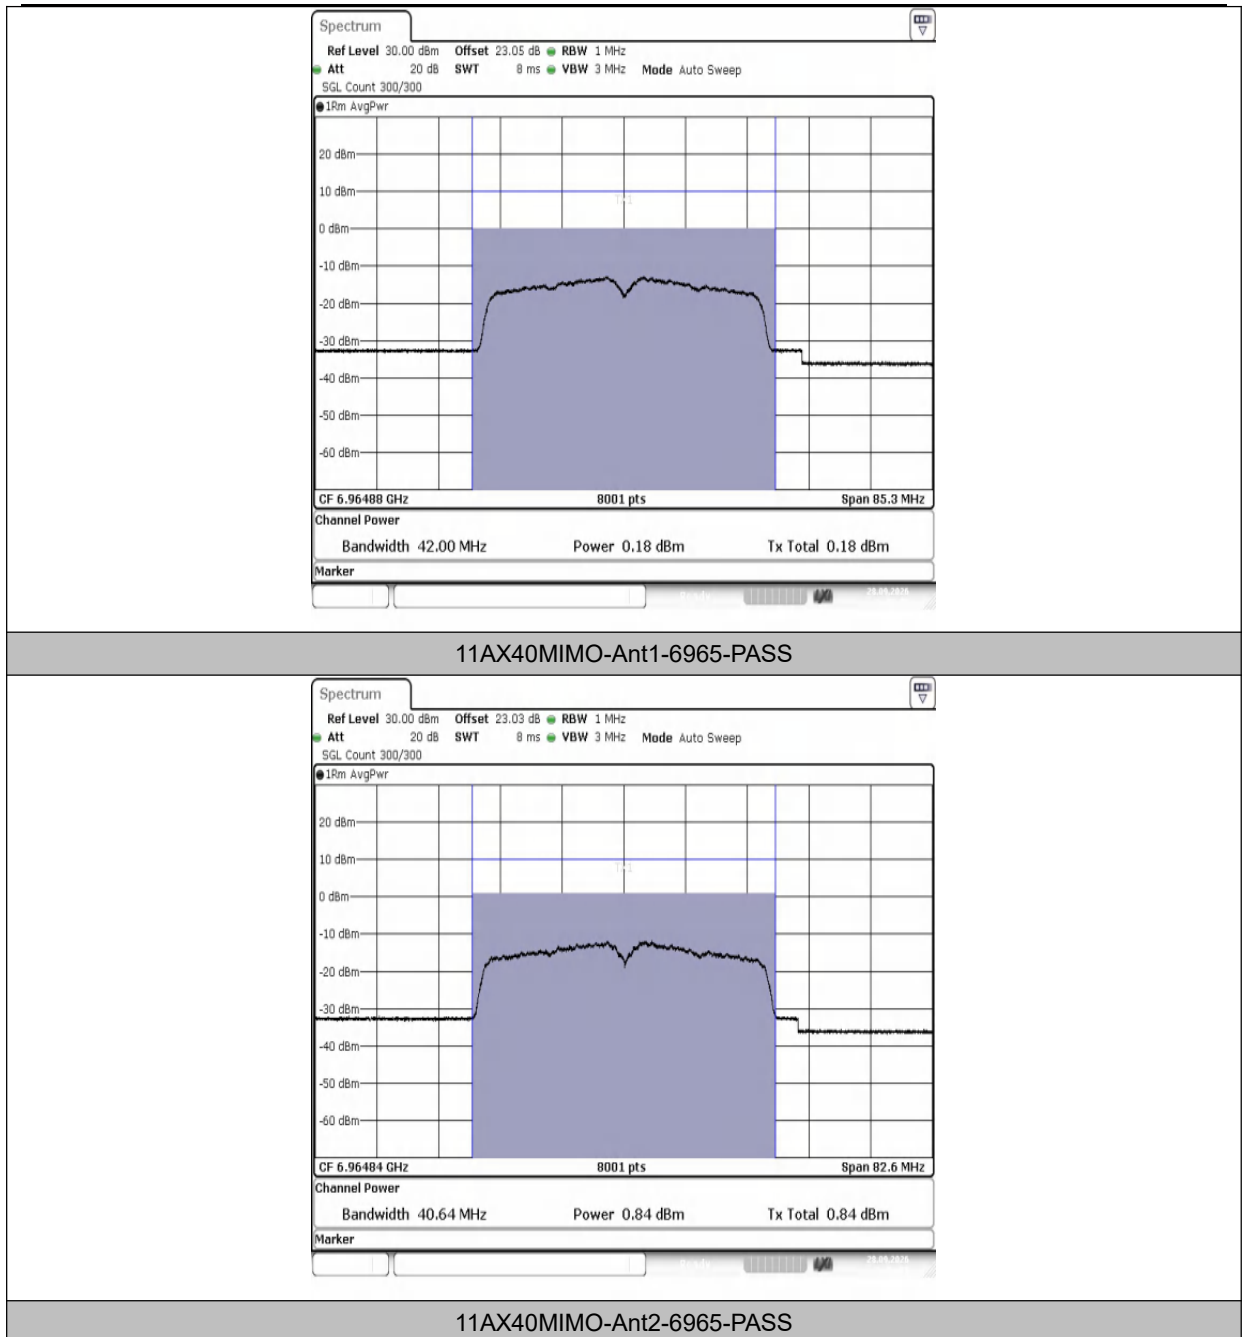

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

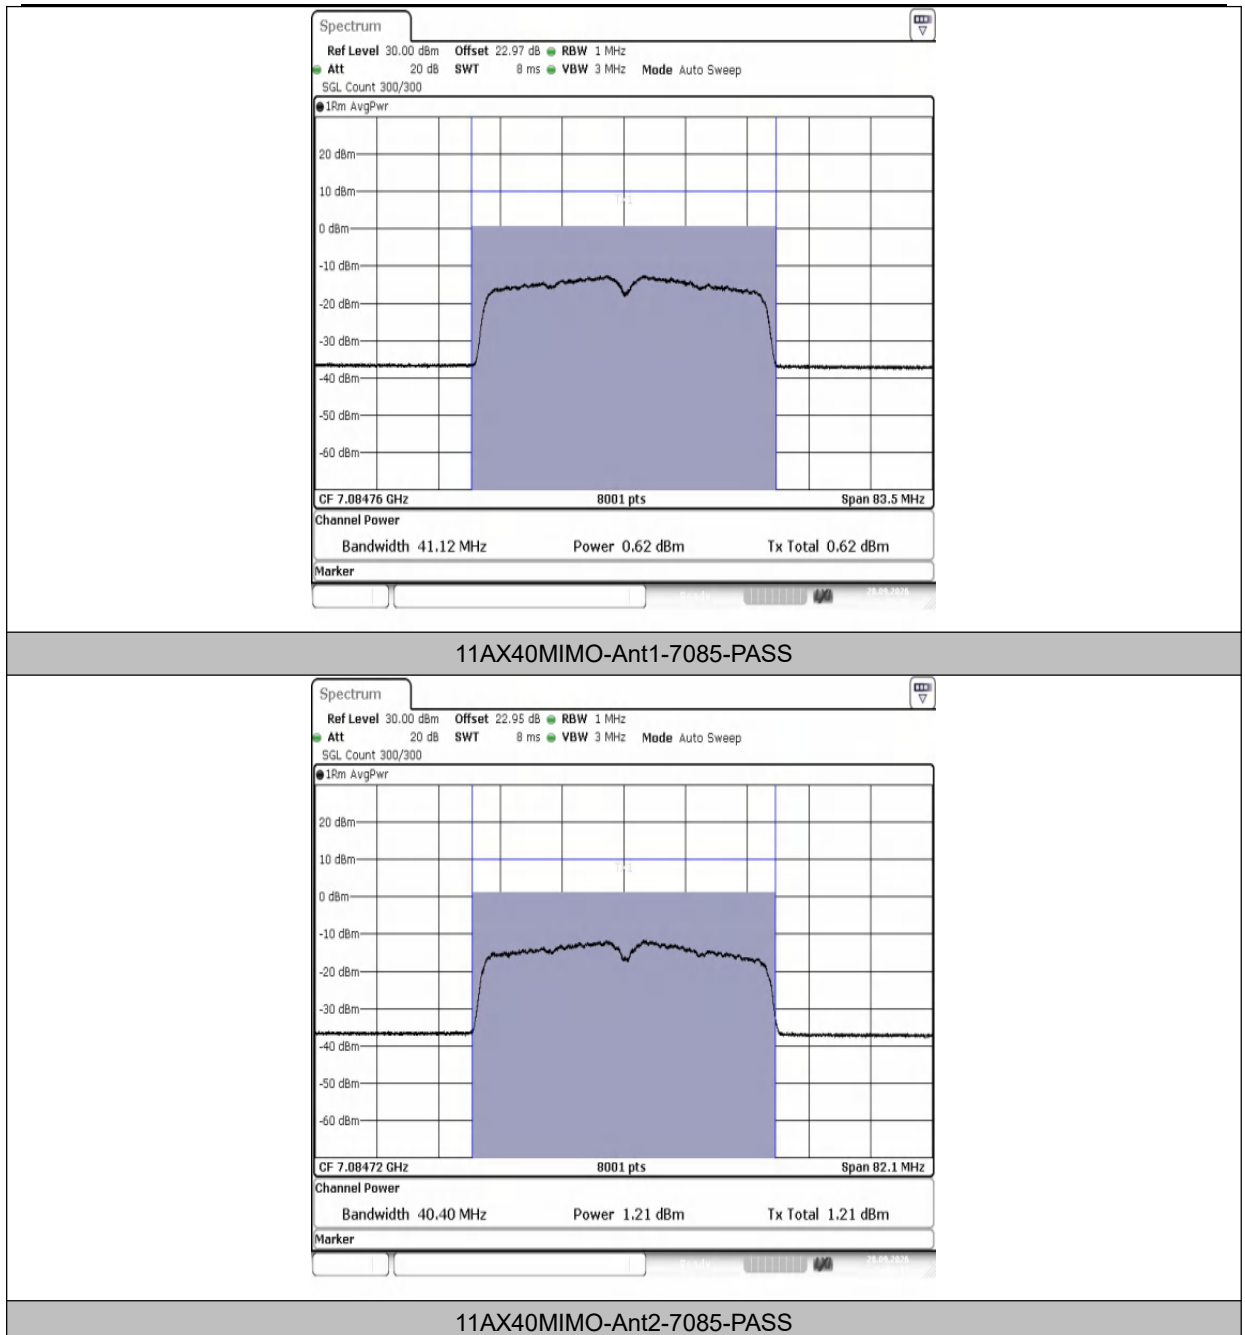

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

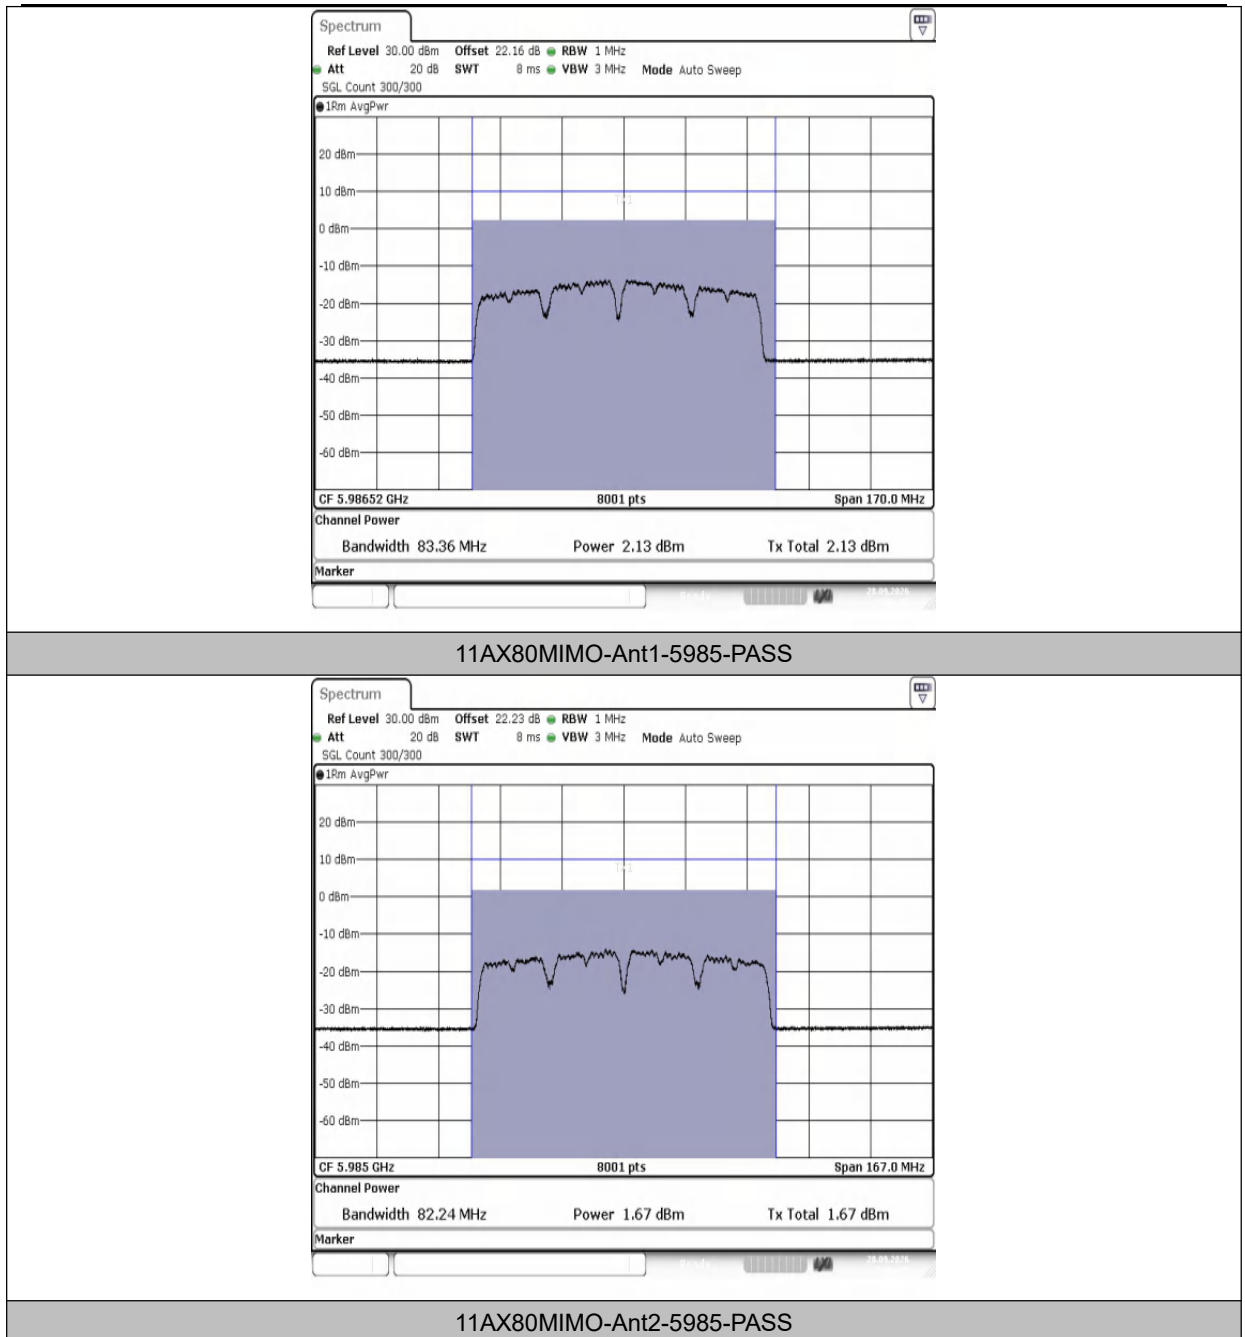

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

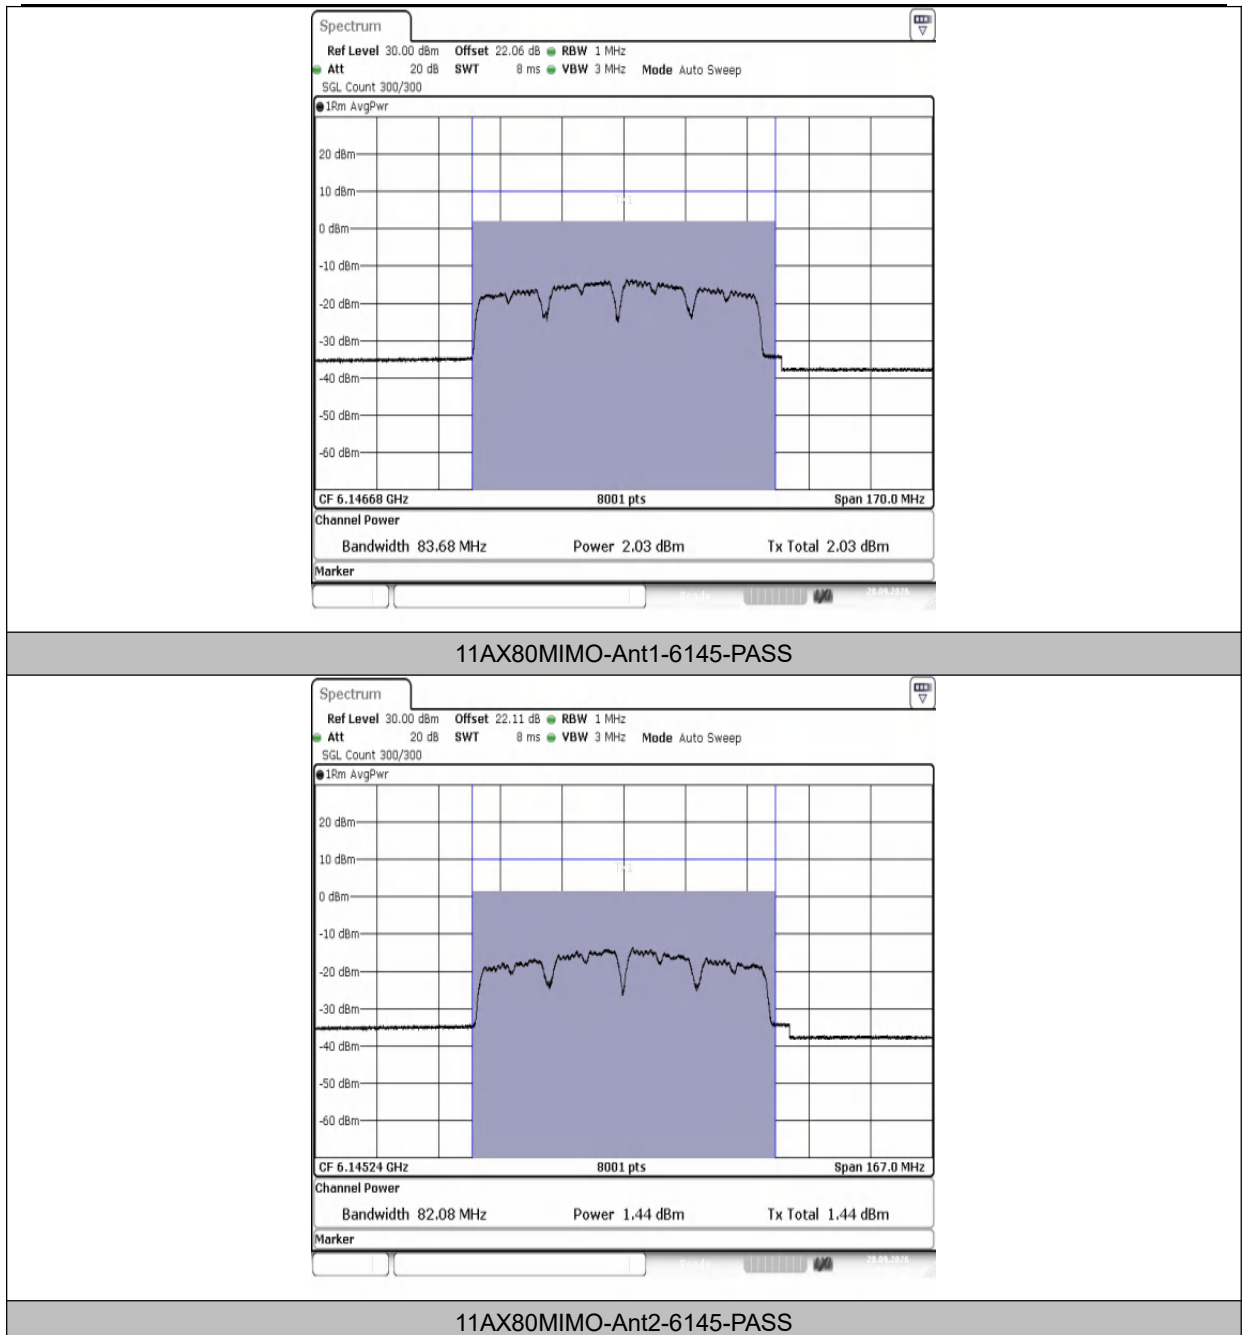

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

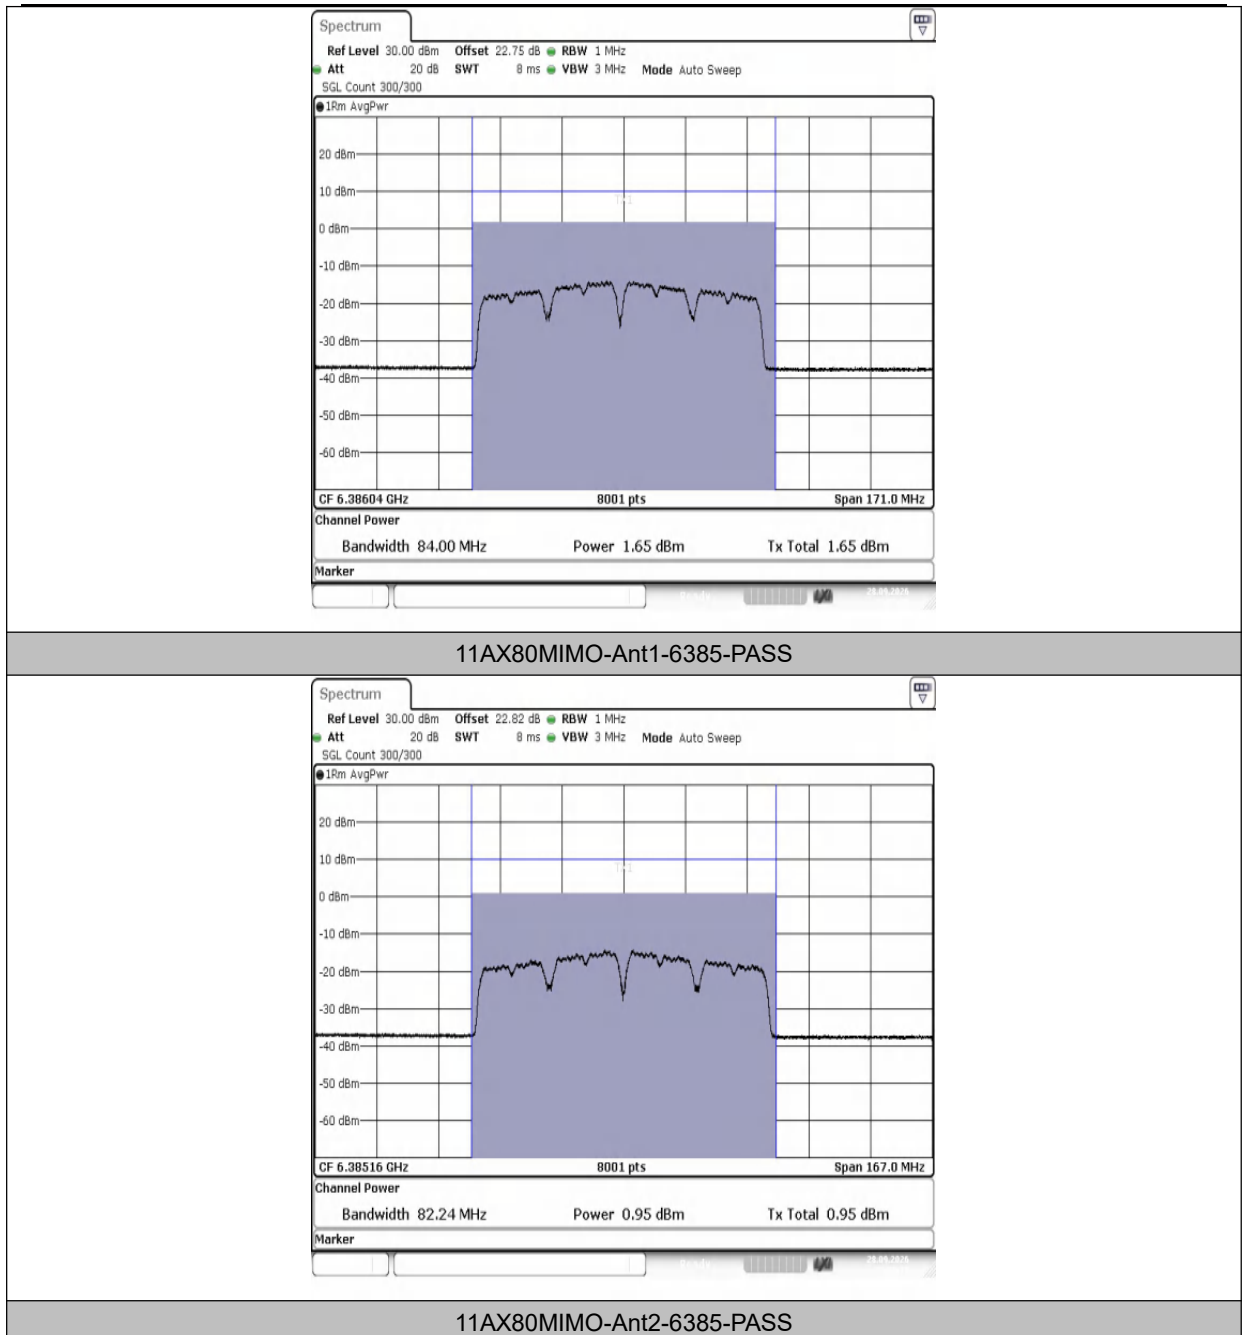


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

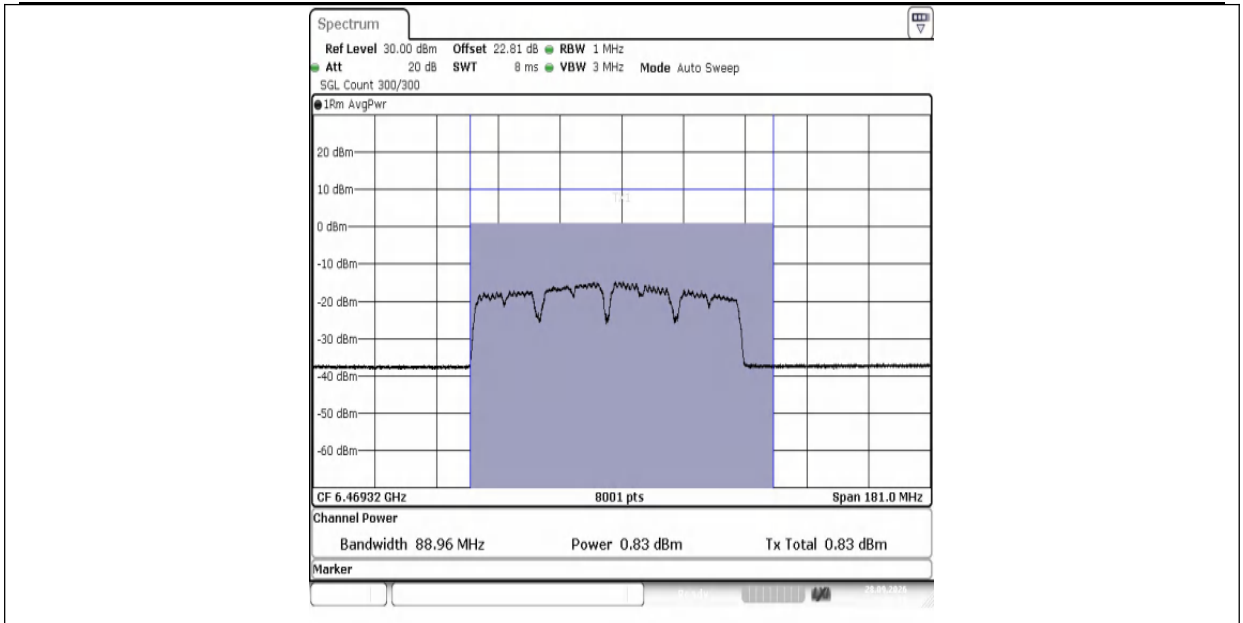


11AX80MIMO-Ant1-6465-PASS

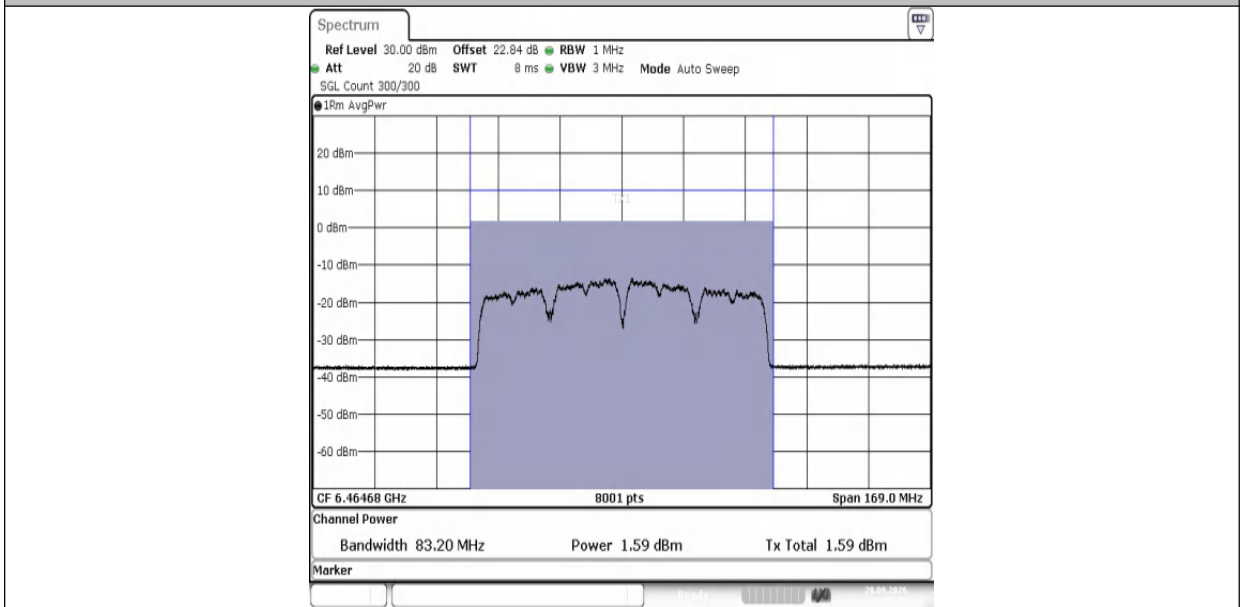


11AX80MIMO-Ant2-6465-PASS

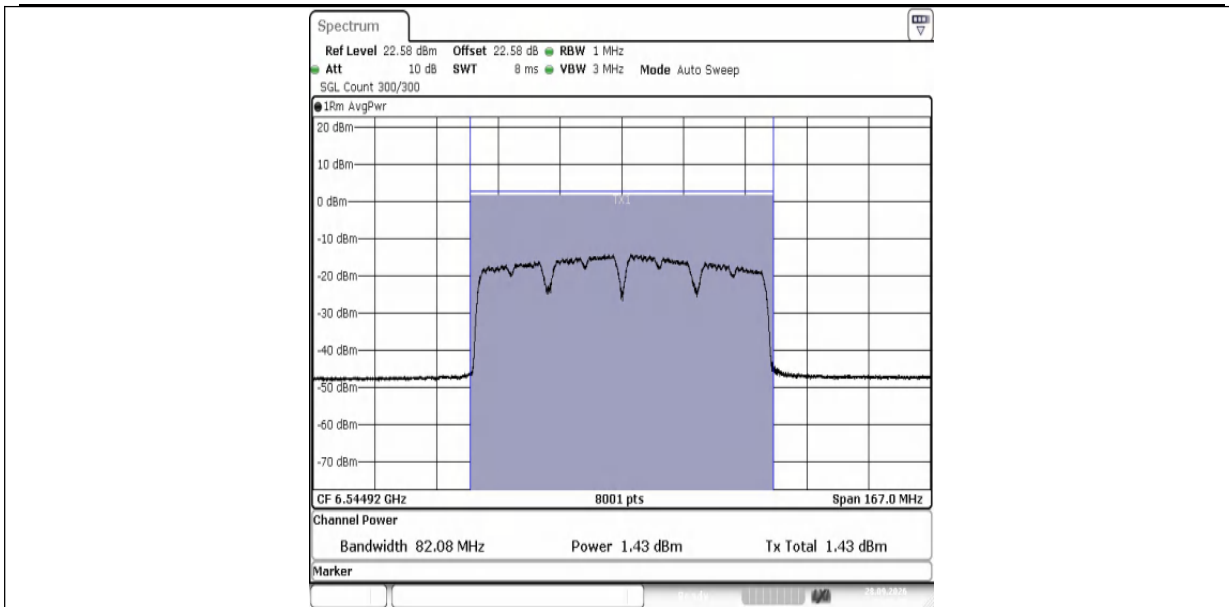


11AX80MIMO-Ant1-6545-PASS

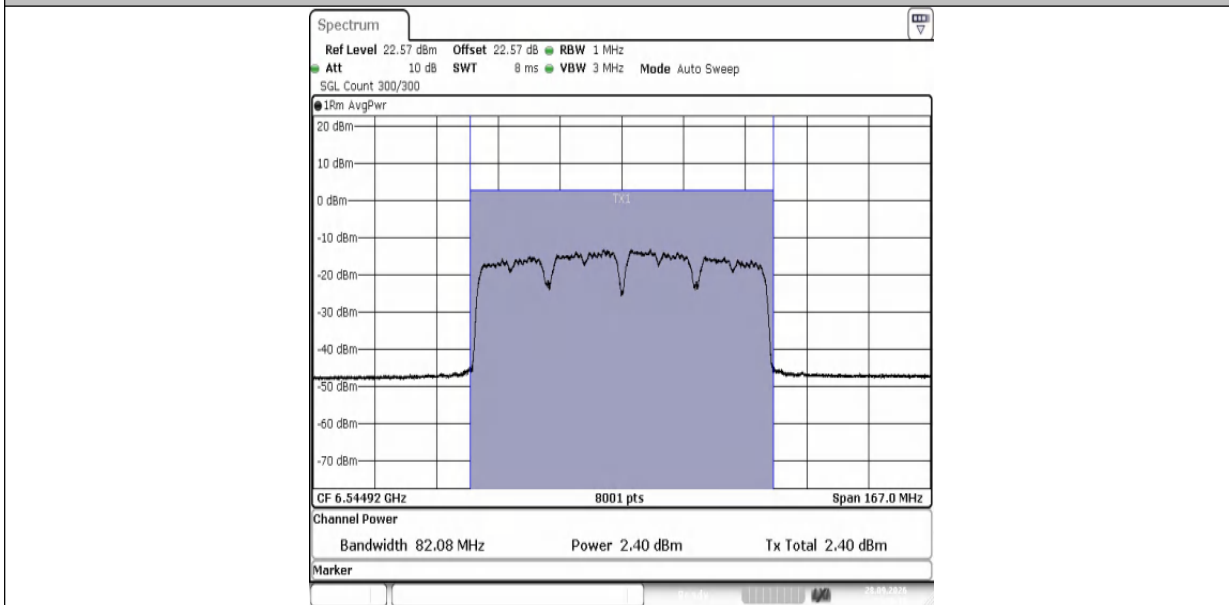


11AX80MIMO-Ant2-6545-PASS

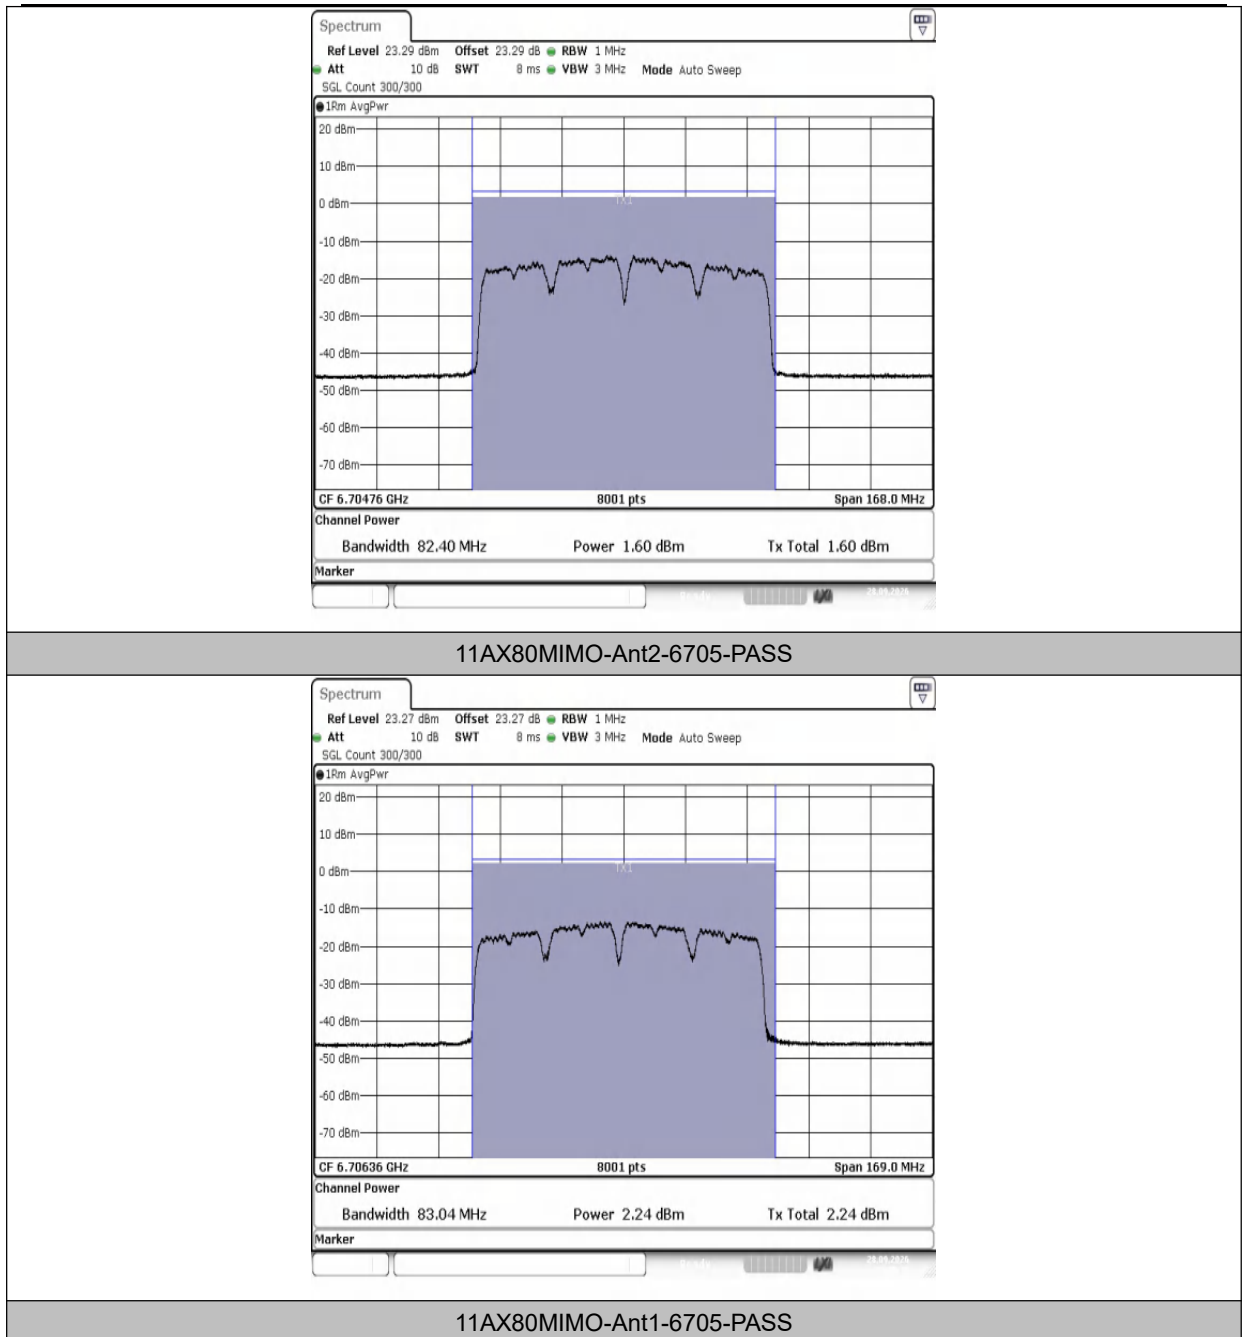


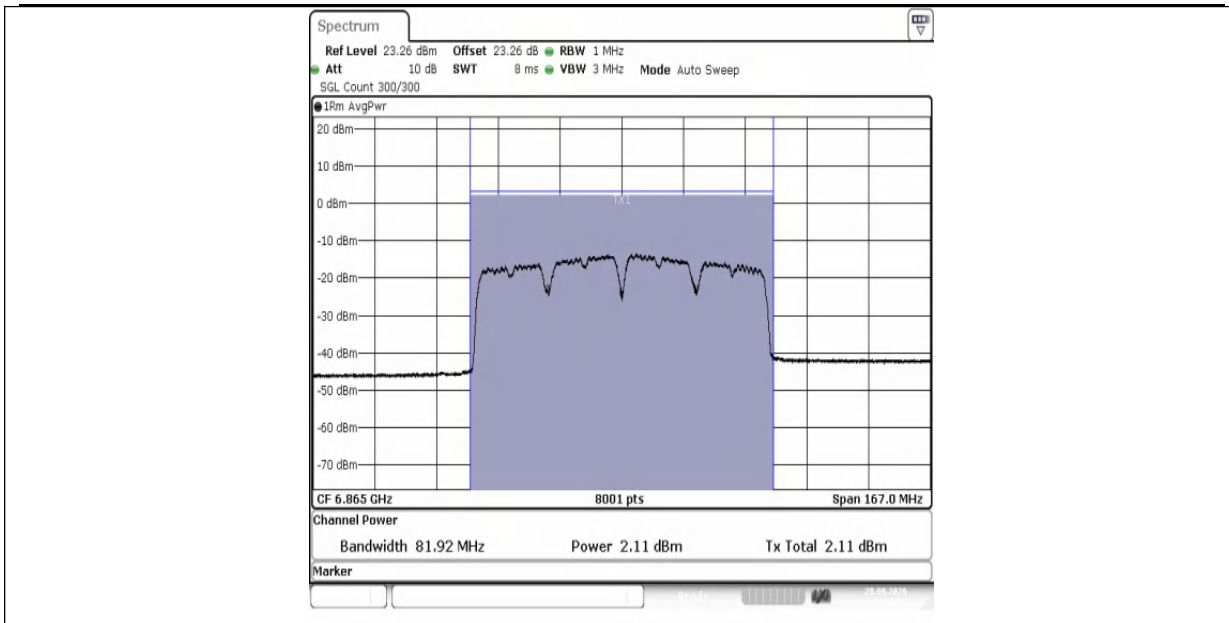


11AX80MIMO-Ant1-6865-PASS

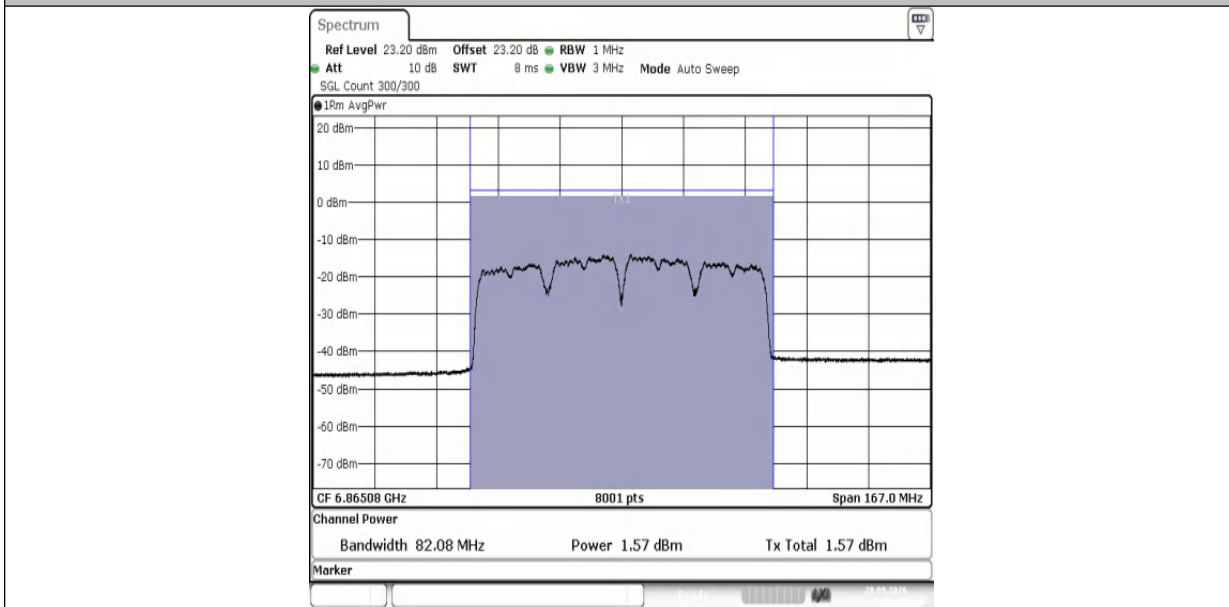


11AX80MIMO-Ant2-6865-PASS

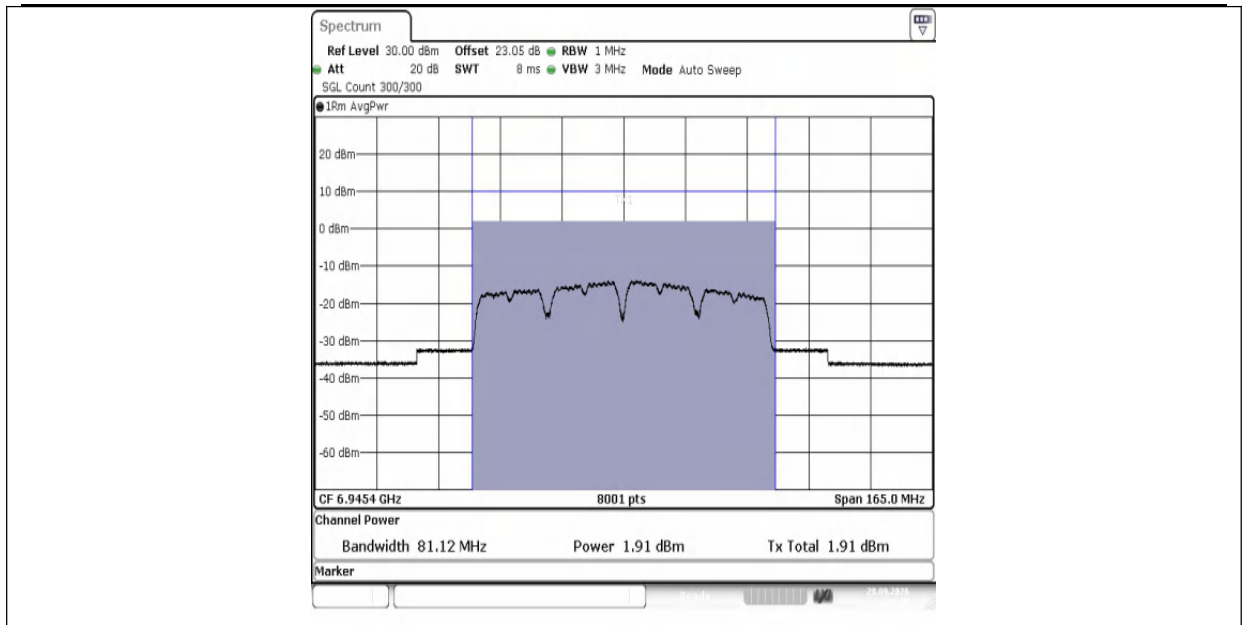

11AX80MIMO-Ant1-6945-PASS

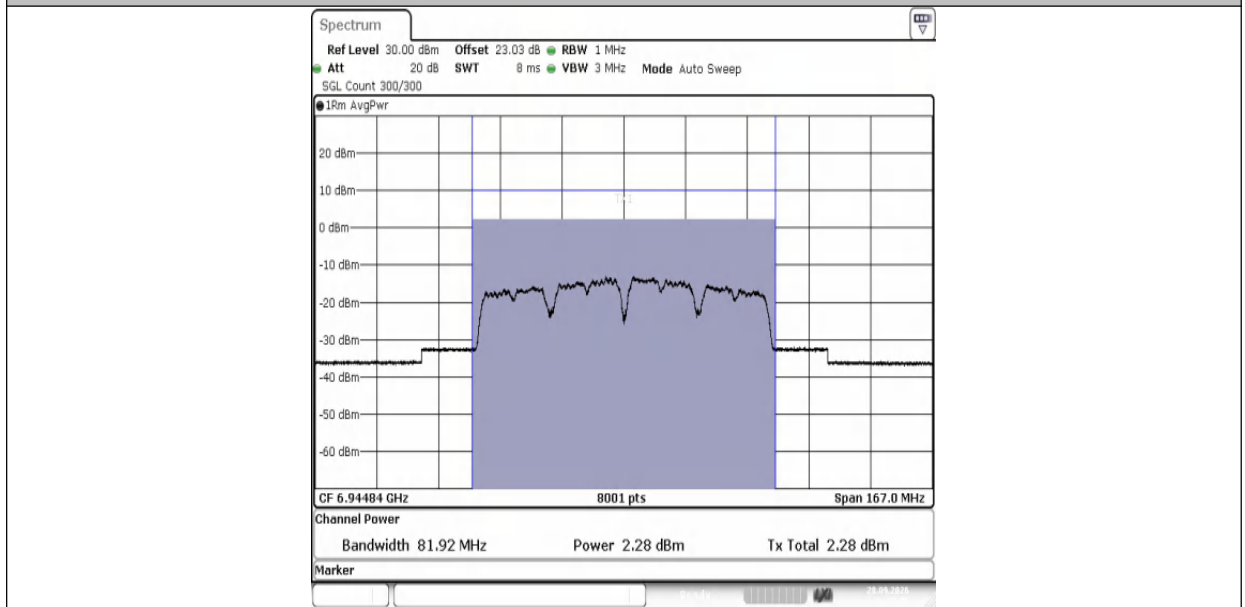

11AX80MIMO-Ant2-6945-PASS

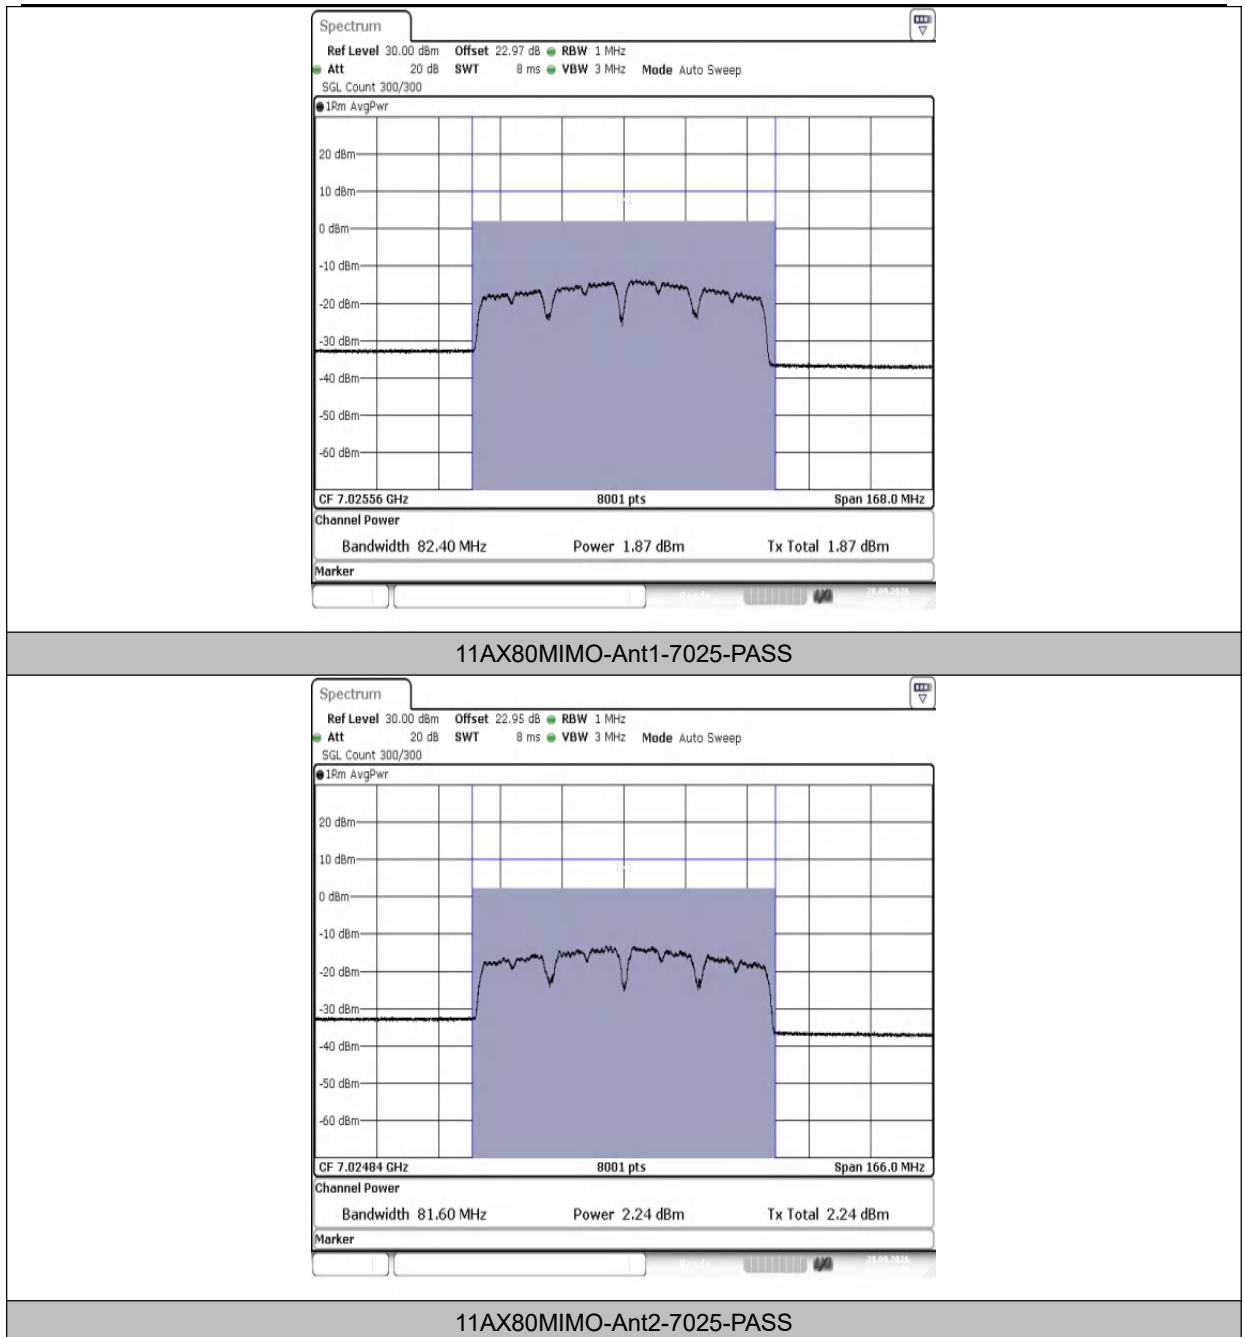

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum power spectral density

Test Result

TestModel	Antenna	Frequency [MHz]	SA [dBm/MHz]	DC Factor [dBm]	Result [dBm/MHz]	Limit [dBm/MHz]	Gain [dBi]	EIRP [dBm/MHz]	Limit [dBm/MHz]	Verdict
11AX20MIMO	Ant1	5955	-10.68	0.17	-10.51	≤1.60	3.4	-7.11	≤-1.00	PASS
11AX20MIMO	Ant2	5955	-12.1	0.13	-11.97	≤1.60	3.4	-8.57	≤-1.00	PASS
11AX20MIMO	total	5955	---	---	-8.17	≤1.60	6.41	-1.76	≤-1.00	PASS
11AX20MIMO	Ant1	6175	-10.24	0.17	-10.07	≤1.60	3.4	-6.67	≤-1.00	PASS
11AX20MIMO	Ant2	6175	-11.74	0.17	-11.57	≤1.60	3.4	-8.17	≤-1.00	PASS
11AX20MIMO	total	6175	---	---	-7.75	≤1.60	6.41	-1.34	≤-1.00	PASS
11AX20MIMO	Ant1	6415	-10.98	0.17	-10.81	≤1.60	3.4	-7.41	≤-1.00	PASS
11AX20MIMO	Ant2	6415	-11.33	0.13	-11.2	≤1.60	3.4	-7.8	≤-1.00	PASS
11AX20MIMO	total	6415	---	---	-7.99	≤1.60	6.41	-1.58	≤-1.00	PASS
11AX20MIMO	Ant1	6435	-10.89	0.17	-10.72	≤1.68	3.32	-7.4	≤-1.00	PASS
11AX20MIMO	Ant2	6435	-11.4	0.17	-11.23	≤1.60	3.4	-7.83	≤-1.00	PASS
11AX20MIMO	total	6435	---	---	-7.96	≤1.60	6.41	-1.55	≤-1.00	PASS
11AX20MIMO	Ant1	6475	-12.25	0.17	-12.08	≤1.68	3.32	-8.76	≤-1.00	PASS
11AX20MIMO	Ant2	6475	-10.43	0.17	-10.26	≤1.60	3.4	-6.86	≤-1.00	PASS
11AX20MIMO	total	6475	---	---	-8.07	≤1.60	6.41	-1.66	≤-1.00	PASS
11AX20MIMO	Ant1	6515	-12.14	0.17	-11.97	≤1.68	3.32	-8.65	≤-1.00	PASS
11AX20MIMO	Ant2	6515	-10.89	0.17	-10.72	≤1.60	3.4	-7.32	≤-1.00	PASS
11AX20MIMO	total	6515	---	---	-8.29	≤1.60	6.41	-1.88	≤-1.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX2 0MIMO	Ant1	6535	-11.01	0.17	-10.84	≤1.60	3.4	-7.44	≤-1.00	PASS
11AX2 0MIMO	Ant2	6535	-11.13	0.17	-10.96	≤1.60	3.4	-7.56	≤-1.00	PASS
11AX2 0MIMO	total	6535	---	---	-7.89	≤1.60	6.41	-1.48	≤-1.00	PASS
11AX2 0MIMO	Ant1	6695	-11.63	0.17	-11.46	≤1.60	3.4	-8.06	≤-1.00	PASS
11AX2 0MIMO	Ant2	6695	-12.6	0.17	-12.43	≤1.60	3.4	-9.03	≤-1.00	PASS
11AX2 0MIMO	total	6695	---	---	-8.91	≤1.60	6.41	-2.5	≤-1.00	PASS
11AX2 0MIMO	Ant1	6855	-11	0.17	-10.83	≤1.60	3.4	-7.43	≤-1.00	PASS
11AX2 0MIMO	Ant2	6855	-10.86	0.17	-10.69	≤1.60	3.4	-7.29	≤-1.00	PASS
11AX2 0MIMO	total	6855	---	---	-7.75	≤1.60	6.41	-1.34	≤-1.00	PASS
11AX2 0MIMO	Ant1	6875	-11.15	0.13	-11.02	≤1.60	3.4	-7.62	≤-1.00	PASS
11AX2 0MIMO	Ant2	6875	-12.44	0.17	-12.27	≤1.60	3.4	-8.87	≤-1.00	PASS
11AX2 0MIMO	total	6875	---	---	-8.59	≤1.60	6.41	-2.18	≤-1.00	PASS
11AX2 0MIMO	Ant1	6895	-11.11	0.13	-10.98	≤1.60	3.4	-7.58	≤-1.00	PASS
11AX2 0MIMO	Ant2	6895	-12.32	0.13	-12.19	≤1.60	3.4	-8.79	≤-1.00	PASS
11AX2 0MIMO	total	6895	---	---	-8.53	≤1.60	6.41	-2.12	≤-1.00	PASS
11AX2 0MIMO	Ant1	6995	-11.99	0.17	-11.82	≤1.60	3.4	-8.42	≤-1.00	PASS
11AX2 0MIMO	Ant2	6995	-11.77	0.13	-11.64	≤1.60	3.4	-8.24	≤-1.00	PASS
11AX2 0MIMO	total	6995	---	---	-8.72	≤1.60	6.41	-2.31	≤-1.00	PASS
11AX2 0MIMO	Ant1	7115	-11.15	0.17	-10.98	≤1.60	3.4	-7.58	≤-1.00	PASS
11AX2 0MIMO	Ant2	7115	-12.16	0.17	-11.99	≤1.60	3.4	-8.59	≤-1.00	PASS
11AX2 0MIMO	total	7115	---	---	-8.45	≤1.60	6.41	-2.04	≤-1.00	PASS
11AX4	Ant1	5965	-11.79	1.09	-10.7	≤1.60	3.4	-7.3	≤-1.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

0MIMO										
11AX4 0MIMO	Ant2	5965	-13	1.25	-11.75	≤1.60	3.4	-8.35	≤-1.00	PASS
11AX4 0MIMO	total	5965	---	---	-8.18	≤1.60	6.41	-1.77	≤-1.00	PASS
11AX4 0MIMO	Ant1	6165	-12.64	1.09	-11.55	≤1.60	3.4	-8.15	≤-1.00	PASS
11AX4 0MIMO	Ant2	6165	-13.02	1.25	-11.77	≤1.60	3.4	-8.37	≤-1.00	PASS
11AX4 0MIMO	total	6165	---	---	-8.65	≤1.60	6.41	-2.24	≤-1.00	PASS
11AX4 0MIMO	Ant1	6405	-12.34	1.25	-11.09	≤1.60	3.4	-7.69	≤-1.00	PASS
11AX4 0MIMO	Ant2	6405	-12.33	1.09	-11.24	≤1.60	3.4	-7.84	≤-1.00	PASS
11AX4 0MIMO	total	6405	---	---	-8.15	≤1.60	6.41	-1.74	≤-1.00	PASS
11AX4 0MIMO	Ant1	6445	-13.12	1.25	-11.87	≤1.68	3.32	-8.55	≤-1.00	PASS
11AX4 0MIMO	Ant2	6445	-11.95	1.25	-10.7	≤1.60	3.4	-7.3	≤-1.00	PASS
11AX4 0MIMO	total	6445	---	---	-8.24	≤1.60	6.41	-1.83	≤-1.00	PASS
11AX4 0MIMO	Ant1	6485	-13.92	1.09	-12.83	≤1.68	3.32	-9.51	≤-1.00	PASS
11AX4 0MIMO	Ant2	6485	-12.1	1.09	-11.01	≤1.60	3.4	-7.61	≤-1.00	PASS
11AX4 0MIMO	total	6485	---	---	-8.82	≤1.60	6.41	-2.41	≤-1.00	PASS
11AX4 0MIMO	Ant1	6565	-13.97	1.09	-12.88	≤1.60	3.4	-9.48	≤-1.00	PASS
11AX4 0MIMO	Ant2	6565	-12.43	1.09	-11.34	≤1.60	3.4	-7.94	≤-1.00	PASS
11AX4 0MIMO	total	6565	---	---	-9.03	≤1.60	6.41	-2.62	≤-1.00	PASS
11AX4 0MIMO	Ant2	6685	-12.58	1.09	-11.49	≤1.60	3.4	-8.09	≤-1.00	PASS
11AX4 0MIMO	total	6685	---	---	-8.4	≤1.60	6.41	-1.99	≤-1.00	PASS
11AX4 0MIMO	Ant1	6685	-12.43	1.09	-11.34	≤1.60	3.4	-7.94	≤-1.00	PASS
11AX4 0MIMO	Ant1	6845	-12.98	1.25	-11.73	≤1.60	3.4	-8.33	≤-1.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX4 0MIMO	Ant2	6845	-12.88	1.25	-11.63	≤1.60	3.4	-8.23	≤-1.00	PASS
11AX4 0MIMO	total	6845	---	---	-8.67	≤1.60	6.41	-2.26	≤-1.00	PASS
11AX4 0MIMO	Ant1	6925	-13.23	1.25	-11.98	≤1.60	3.4	-8.58	≤-1.00	PASS
11AX4 0MIMO	Ant2	6925	-12.9	1.09	-11.81	≤1.60	3.4	-8.41	≤-1.00	PASS
11AX4 0MIMO	total	6925	---	---	-8.88	≤1.60	6.41	-2.47	≤-1.00	PASS
11AX4 0MIMO	Ant1	6965	-12.91	1.09	-11.82	≤1.60	3.4	-8.42	≤-1.00	PASS
11AX4 0MIMO	Ant2	6965	-12.21	1.25	-10.96	≤1.60	3.4	-7.56	≤-1.00	PASS
11AX4 0MIMO	total	6965	---	---	-8.36	≤1.60	6.41	-1.95	≤-1.00	PASS
11AX4 0MIMO	Ant1	7085	-12.64	1.09	-11.55	≤1.60	3.4	-8.15	≤-1.00	PASS
11AX4 0MIMO	Ant2	7085	-11.85	1.09	-10.76	≤1.60	3.4	-7.36	≤-1.00	PASS
11AX4 0MIMO	total	7085	---	---	-8.13	≤1.60	6.41	-1.72	≤-1.00	PASS
11AX8 0MIMO	Ant1	5985	-13.66	1.76	-11.9	≤1.60	3.4	-8.5	≤-1.00	PASS
11AX8 0MIMO	Ant2	5985	-13.69	1.76	-11.93	≤1.60	3.4	-8.53	≤-1.00	PASS
11AX8 0MIMO	total	5985	---	---	-8.9	≤1.60	6.41	-2.49	≤-1.00	PASS
11AX8 0MIMO	Ant1	6145	-14.11	2.22	-11.89	≤1.60	3.4	-8.49	≤-1.00	PASS
11AX8 0MIMO	Ant2	6145	-14.12	1.76	-12.36	≤1.60	3.4	-8.96	≤-1.00	PASS
11AX8 0MIMO	total	6145	---	---	-9.11	≤1.60	6.41	-2.7	≤-1.00	PASS
11AX8 0MIMO	Ant1	6385	-14.27	1.76	-12.51	≤1.60	3.4	-9.11	≤-1.00	PASS
11AX8 0MIMO	Ant2	6385	-14.11	1.76	-12.35	≤1.60	3.4	-8.95	≤-1.00	PASS
11AX8 0MIMO	total	6385	---	---	-9.42	≤1.60	6.41	-3.01	≤-1.00	PASS
11AX8 0MIMO	Ant1	6465	-14.27	1.76	-12.51	≤1.68	3.32	-9.19	≤-1.00	PASS
11AX8	Ant2	6465	-13.27	2.22	-11.05	≤1.60	3.4	-7.65	≤-1.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

0MIMO										
11AX8 0MIMO	total	6465	---	---	-8.71	≤1.60	6.41	-2.3	≤-1.00	PASS
11AX8 0MIMO	Ant1	6545	-14.4	1.76	-12.64	≤1.60	3.4	-9.24	≤-1.00	PASS
11AX8 0MIMO	Ant2	6545	-13.67	1.76	-11.91	≤1.60	3.4	-8.51	≤-1.00	PASS
11AX8 0MIMO	total	6545	---	---	-9.25	≤1.60	6.41	-2.84	≤-1.00	PASS
11AX8 0MIMO	Ant1	6705	-13.16	1.76	-11.4	≤1.60	3.4	-8	≤-1.00	PASS
11AX8 0MIMO	Ant2	6705	-13.81	1.76	-12.05	≤1.60	3.4	-8.65	≤-1.00	PASS
11AX8 0MIMO	total	6705	---	---	-8.7	≤1.60	6.41	-2.29	≤-1.00	PASS
11AX8 0MIMO	Ant1	6865	-13.77	1.76	-12.01	≤1.60	3.4	-8.61	≤-1.00	PASS
11AX8 0MIMO	Ant2	6865	-12.65	1.76	-10.89	≤1.60	3.4	-7.49	≤-1.00	PASS
11AX8 0MIMO	total	6865	---	---	-8.4	≤1.60	6.41	-1.99	≤-1.00	PASS
11AX8 0MIMO	Ant1	6945	-13.63	1.76	-11.87	≤1.60	3.4	-8.47	≤-1.00	PASS
11AX8 0MIMO	Ant2	6945	-13.05	1.76	-11.29	≤1.60	3.4	-7.89	≤-1.00	PASS
11AX8 0MIMO	total	6945	---	---	-8.56	≤1.60	6.41	-2.15	≤-1.00	PASS
11AX8 0MIMO	Ant1	7025	-13.53	1.76	-11.77	≤1.60	3.4	-8.37	≤-1.00	PASS
11AX8 0MIMO	Ant2	7025	-13.43	2.22	-11.21	≤1.60	3.4	-7.81	≤-1.00	PASS
11AX8 0MIMO	total	7025	---	---	-8.47	≤1.60	6.41	-2.06	≤-1.00	PASS


Note: 1.The cable loss is compensated in the graph.

3. For Wi-Fi UNII5, Wi-Fi UNII7 and Wi-Fi UNII8, Directional gain = $10 \log[(10^{G1/20} + 10^{G2/20})^2 / N_{ANT}]$ dBi = $10 \log[(10^{3.4/20} + 10^{3.4/20})^2 / 2]$ dBi = 6.41dBi.

For Wi-Fi UNII6, As Directional gain = $10 \log[(10^{G1/20} + 10^{G2/20})^2 / N_{ANT}]$ dBi = $10 \log[(10^{3.32/20} + 10^{3.4/20})^2 / 2]$ dBi = 6.37dBi.

3. MIMO = $10 * \log((10^{ANT1/10}) + 10^{(ANT2/10)})$


Test Graphs

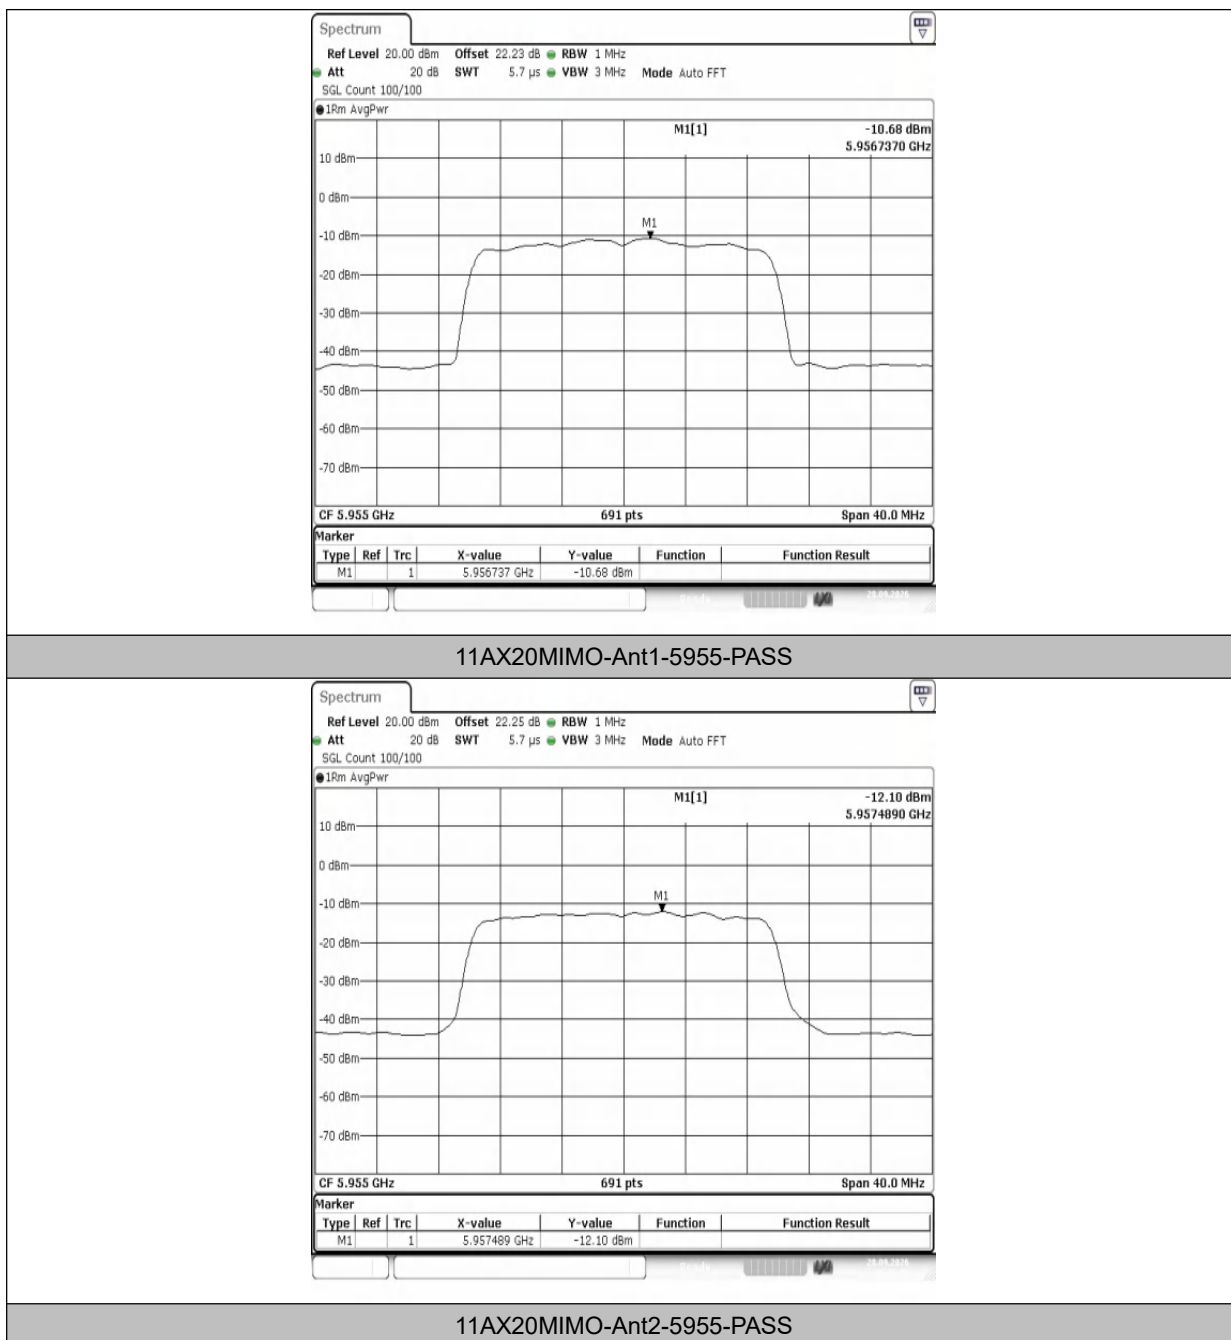


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

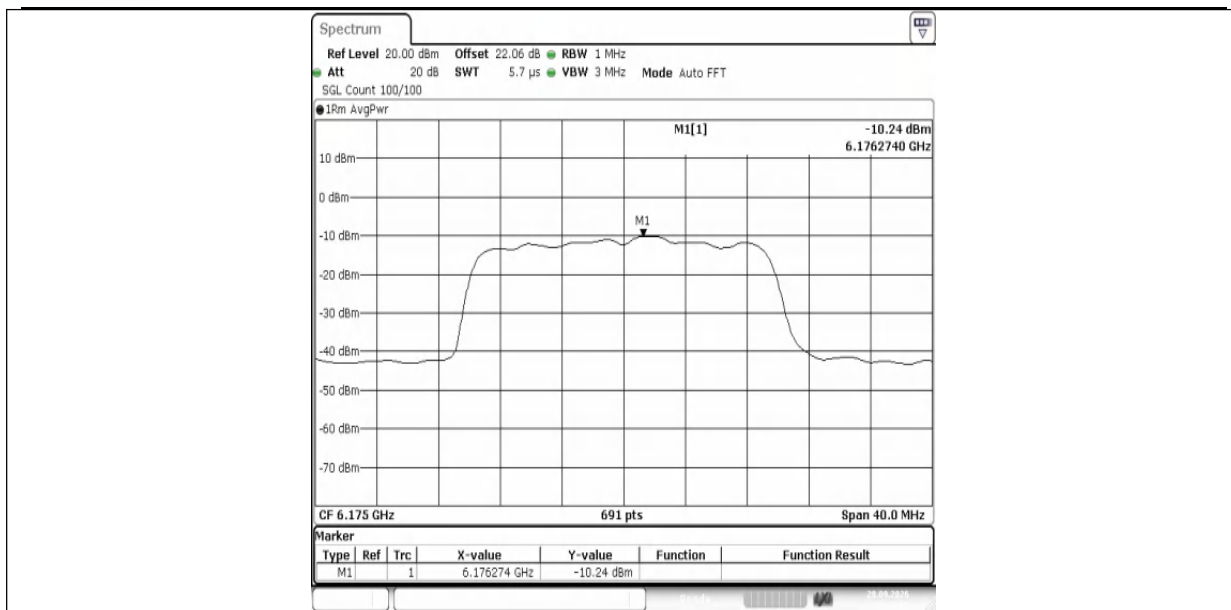

11AX20MIMO-Ant1-6175-PASS

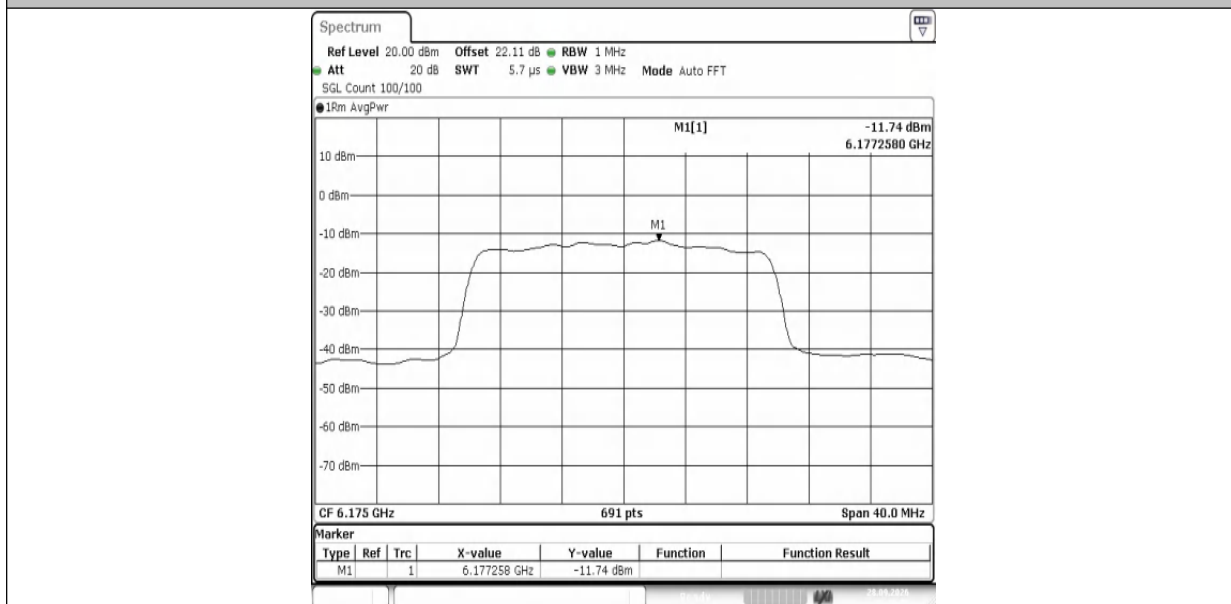


11AX20MIMO-Ant2-6175-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

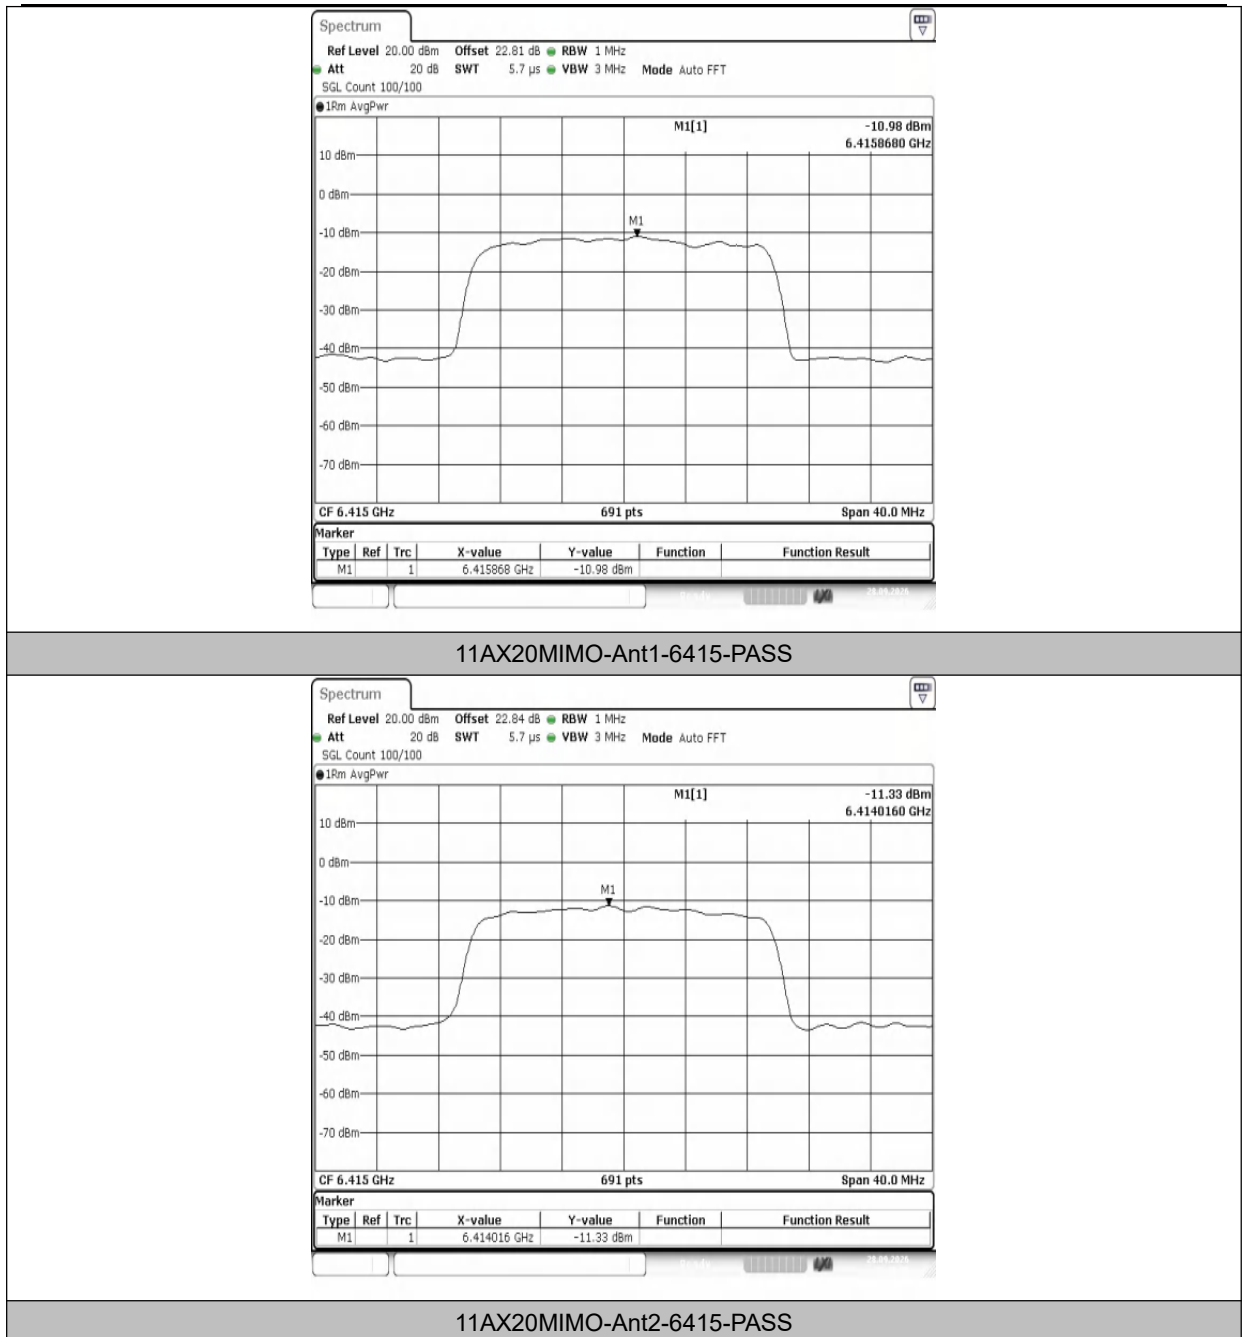

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

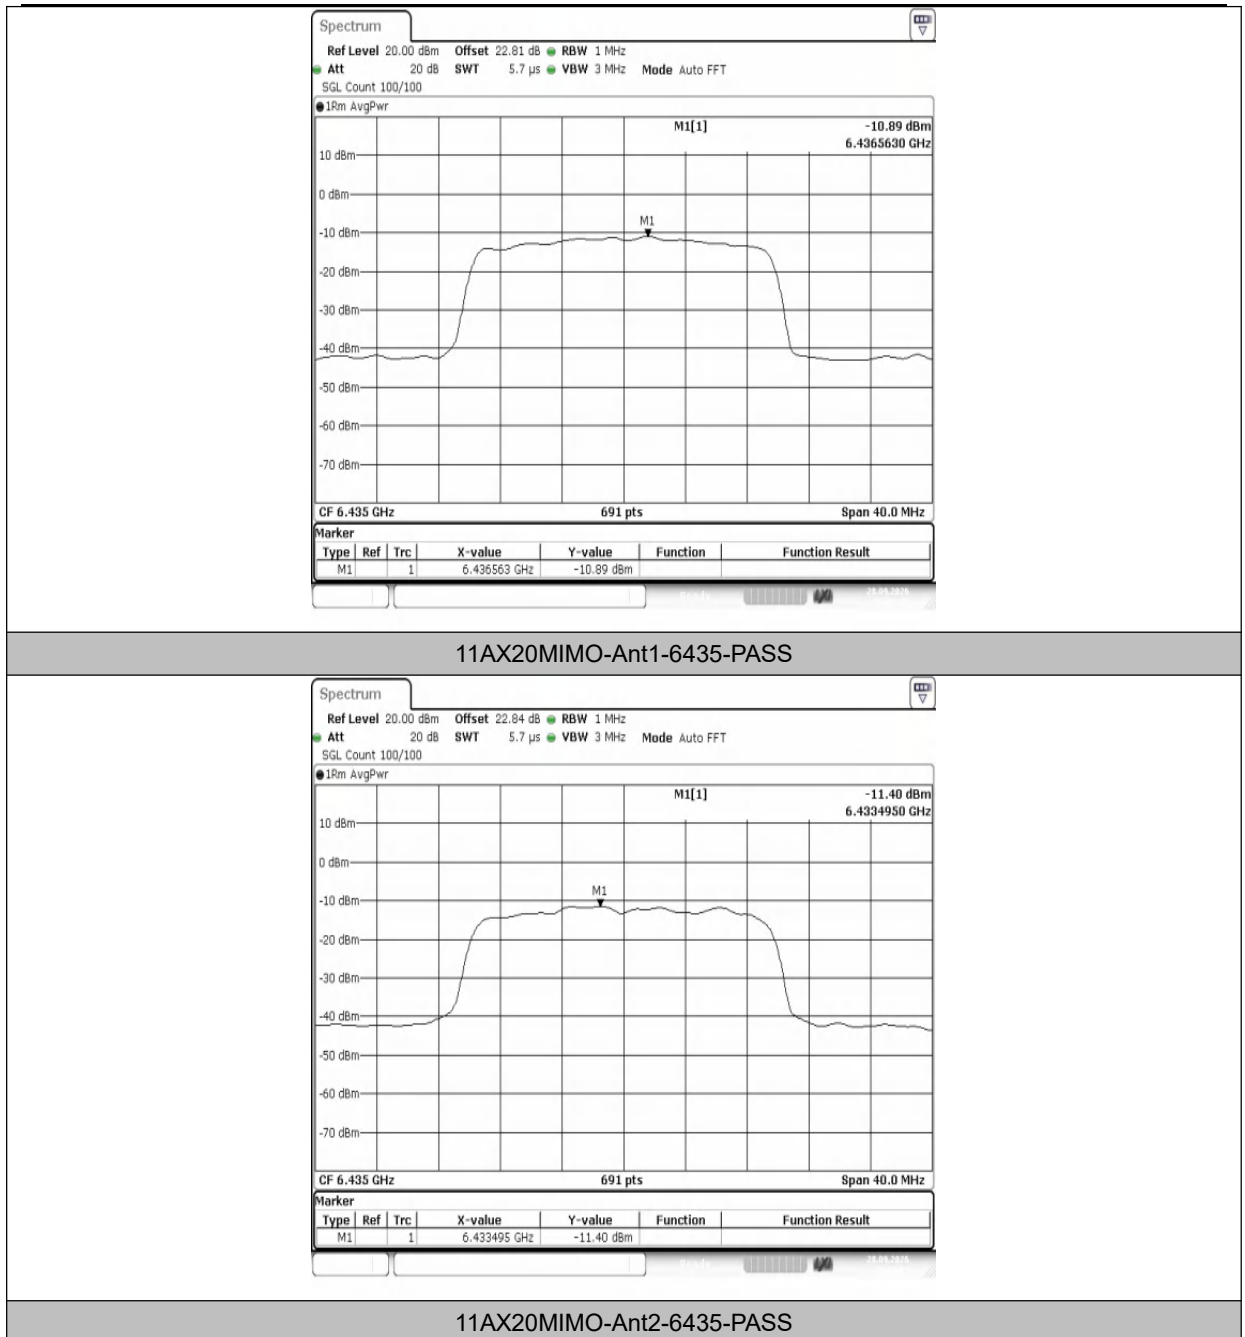


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

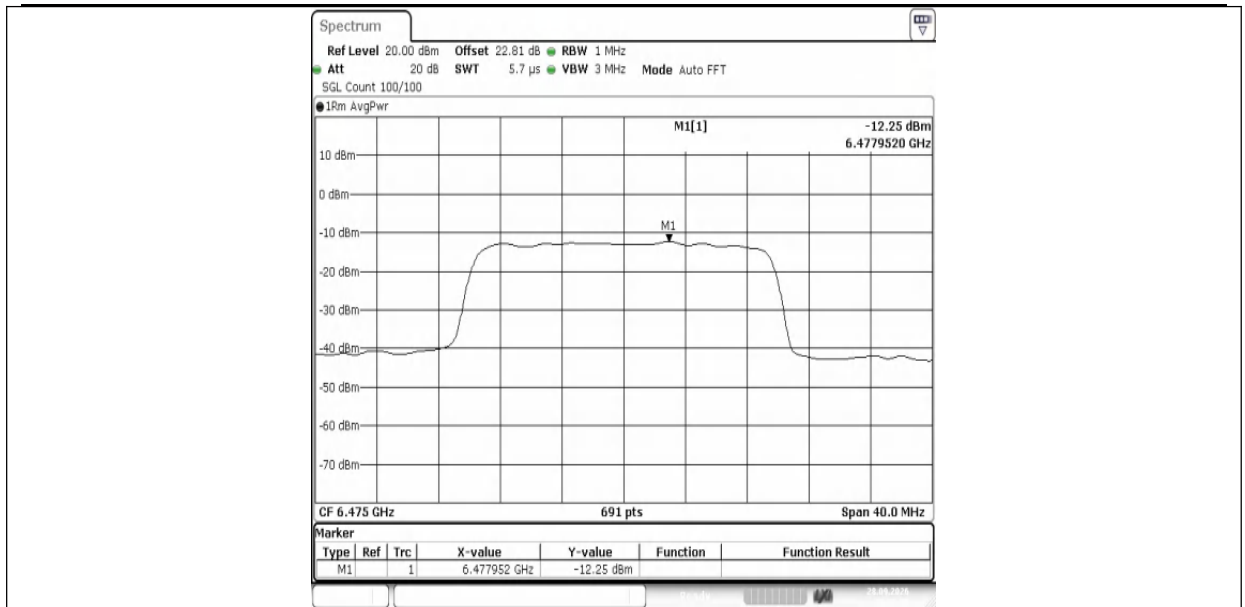

11AX20MIMO-Ant1-6475-PASS

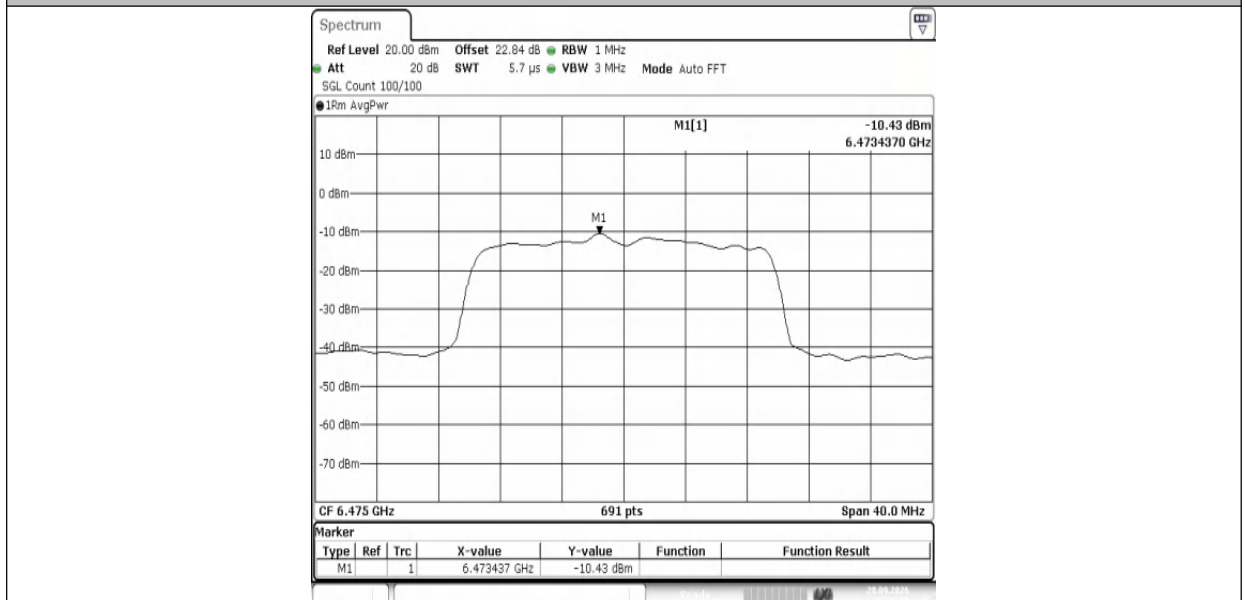

11AX20MIMO-Ant2-6475-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com