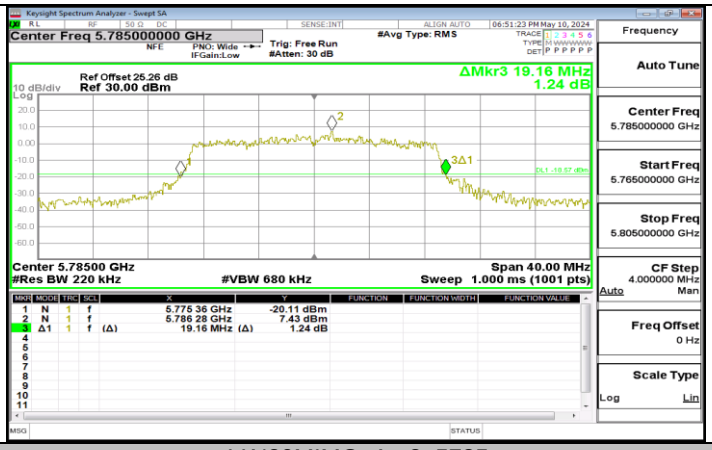

11N20MIMO_Ant3_5785

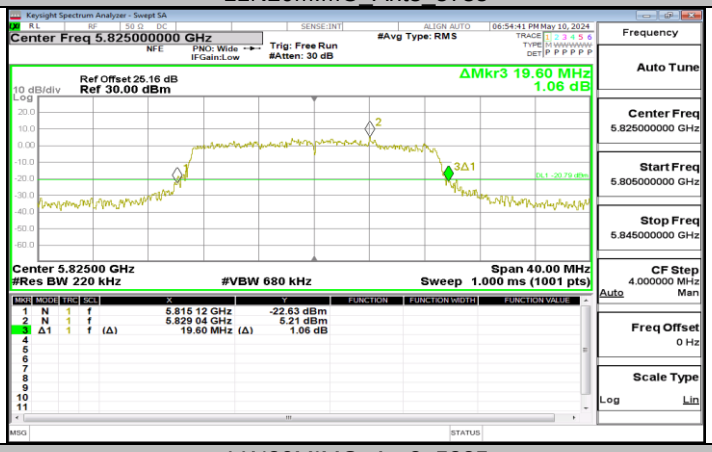

11N20MIMO_Ant2_5825

11N20MIMO_Ant3_5825

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

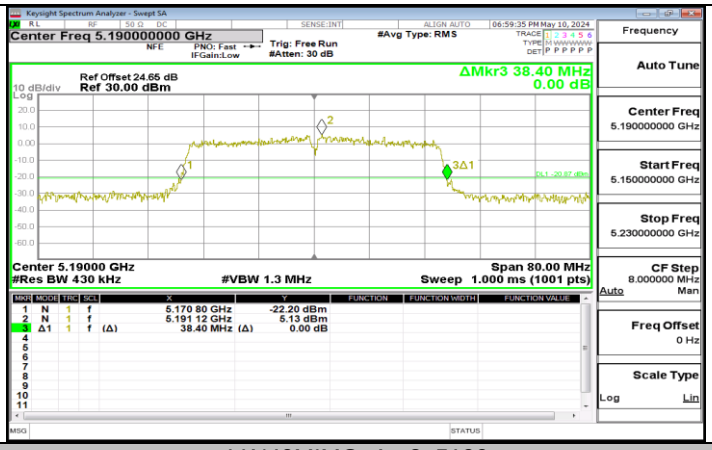

11N40MIMO_Ant2_5190

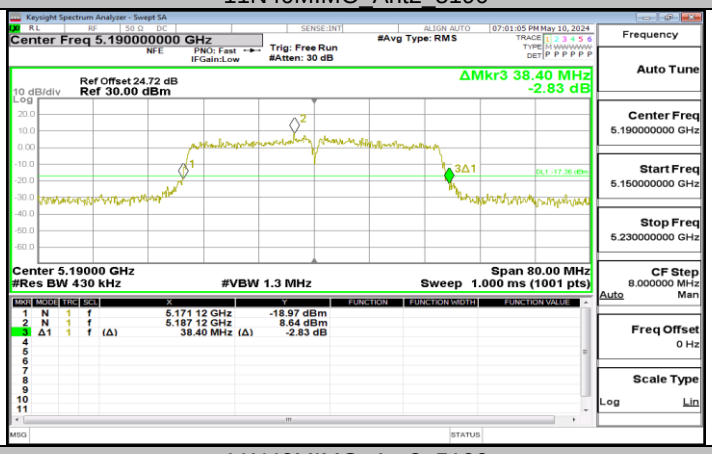

11N40MIMO_Ant3_5190

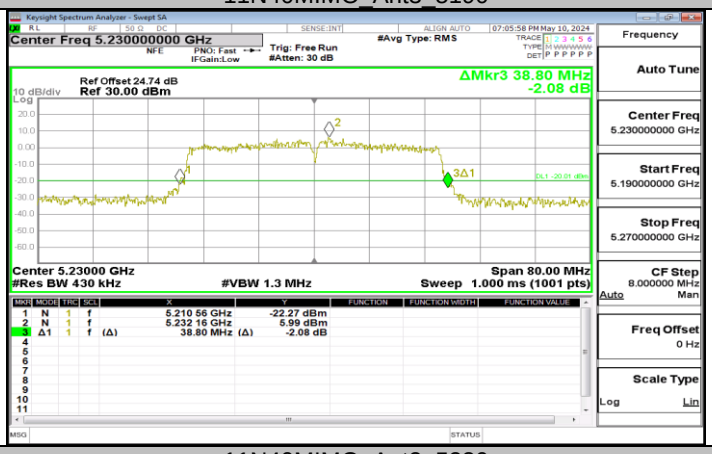

11N40MIMO_Ant2_5230

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

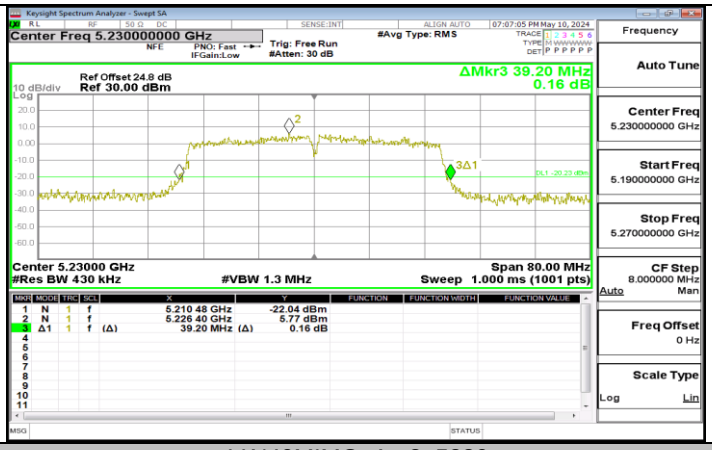

11N40MIMO_Ant3_5230

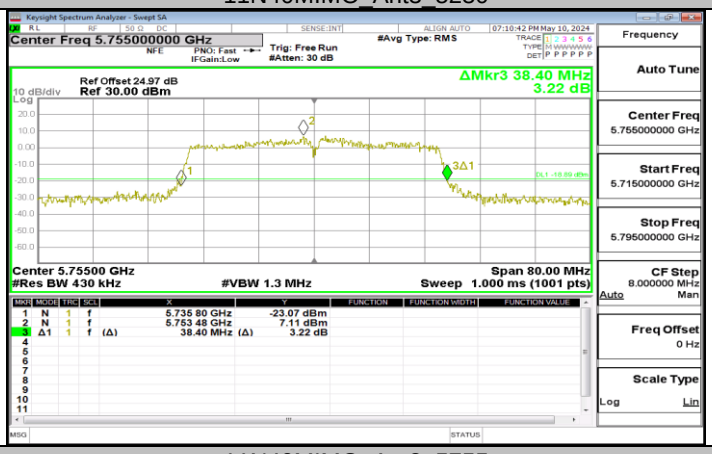

11N40MIMO_Ant2_5755

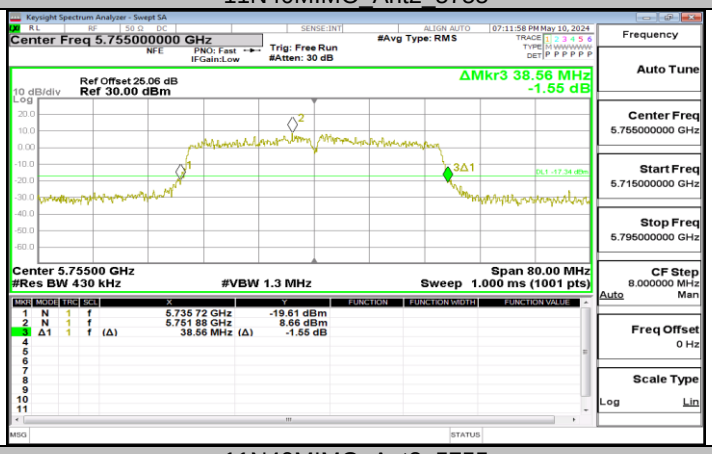

11N40MIMO_Ant3_5755

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

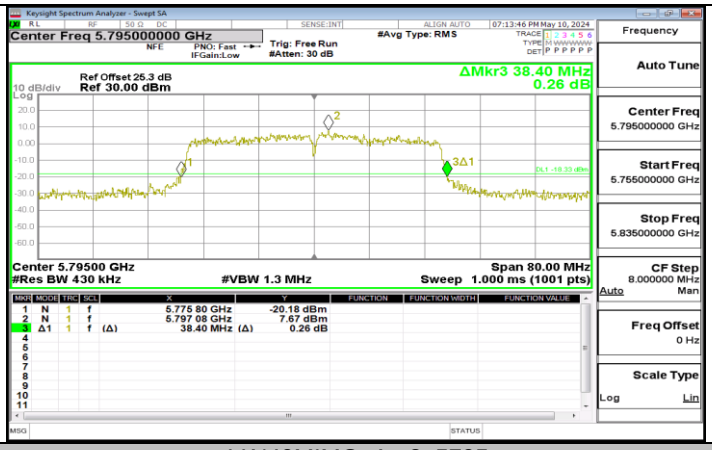

11N40MIMO_Ant2_5795

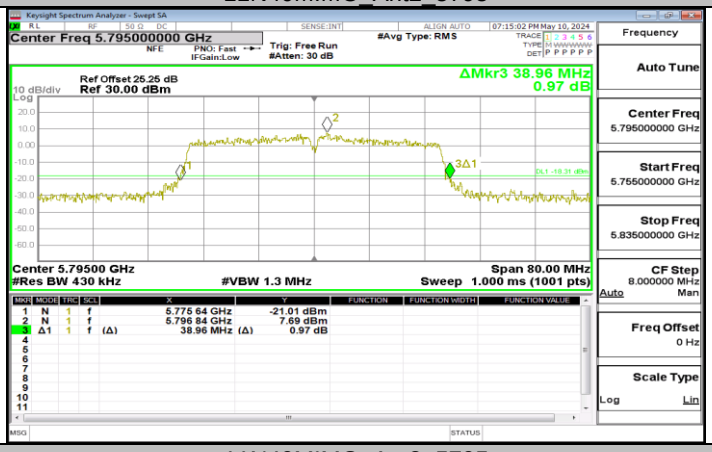

11N40MIMO_Ant3_5795

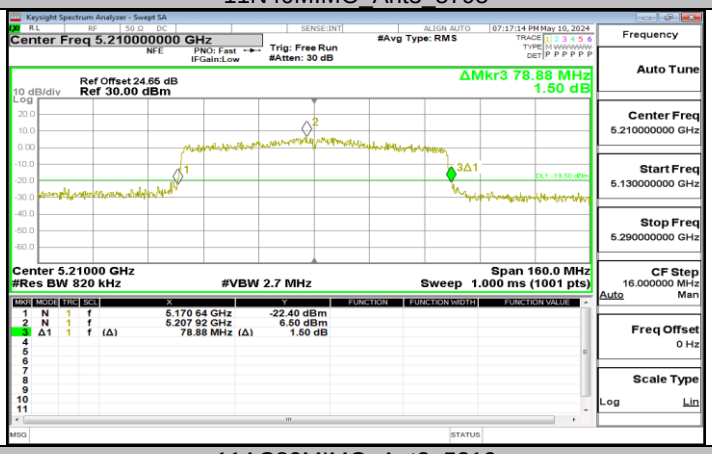

11AC80MIMO_Ant2_5210

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

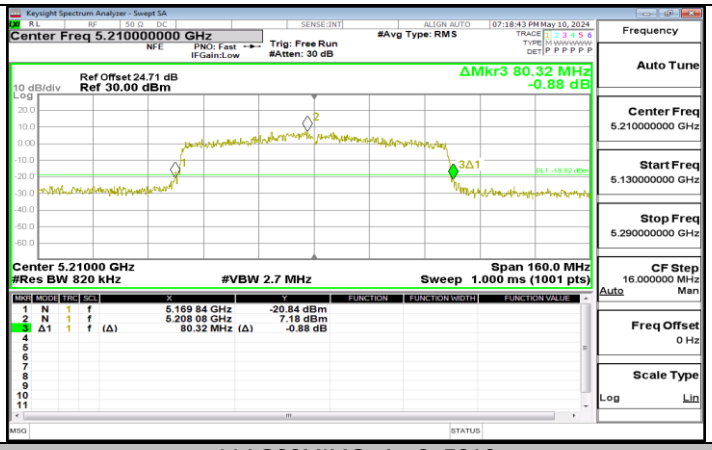

11AC80MIMO_Ant3_5210

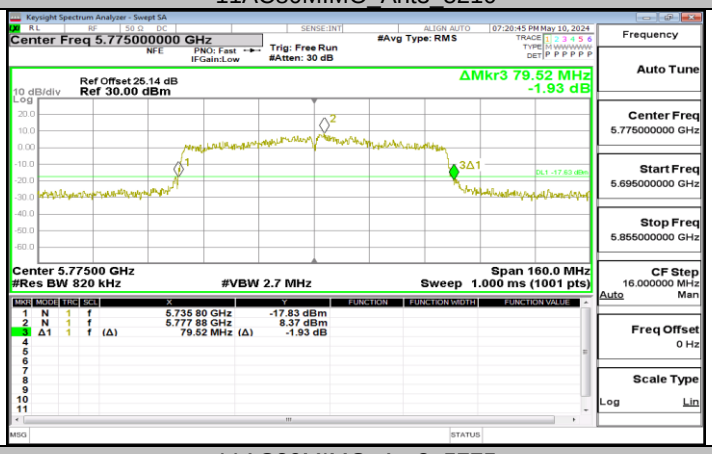

11AC80MIMO_Ant2_5775

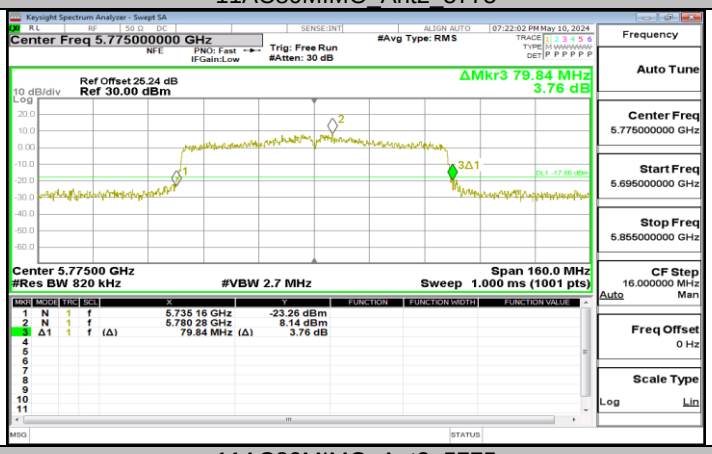

11AC80MIMO_Ant3_5775

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

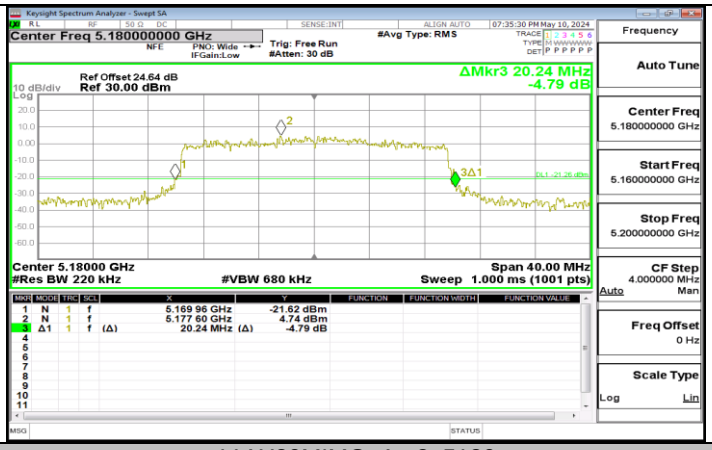

11AX20MIMO_Ant2_5180

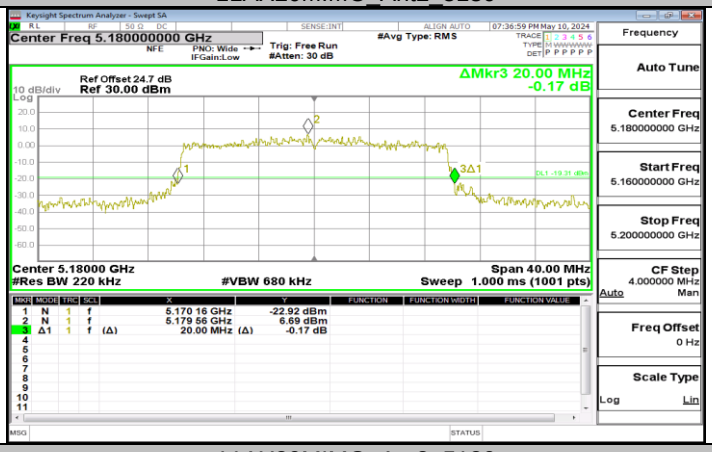

11AX20MIMO_Ant3_5180

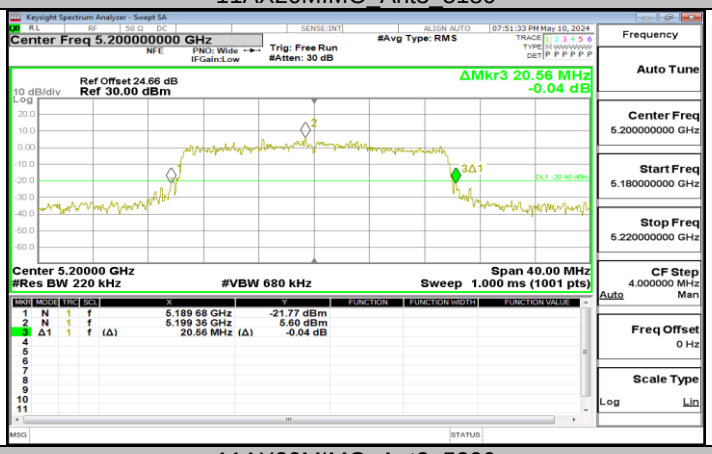

11AX20MIMO_Ant2_5200

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

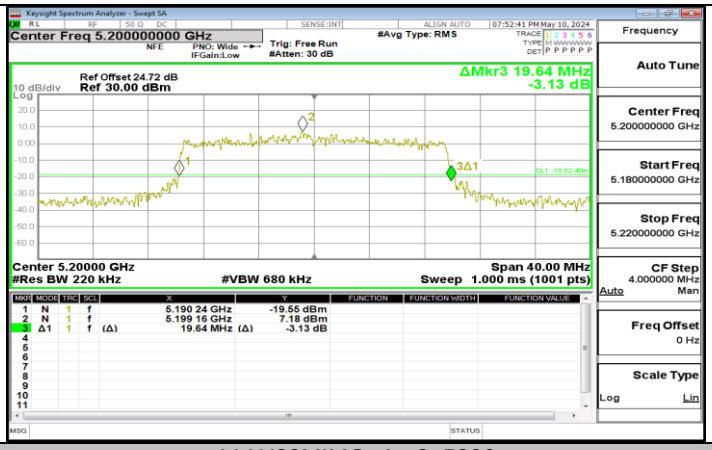

11AX20MIMO_Ant3_5200

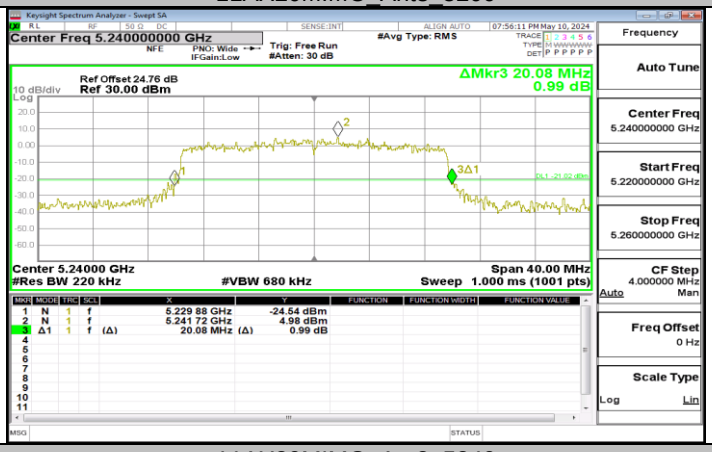

11AX20MIMO_Ant2_5240

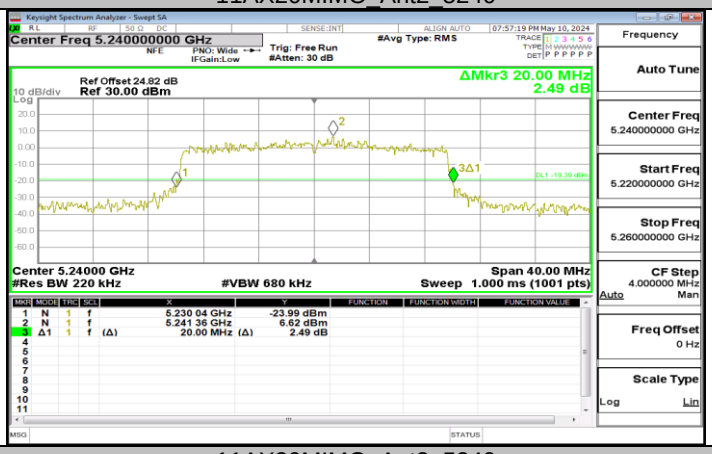

11AX20MIMO_Ant3_5240

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

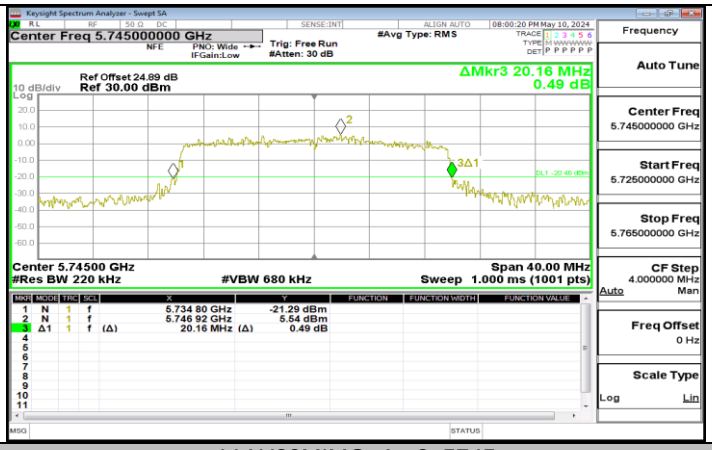

11AX20MIMO_Ant2_5745

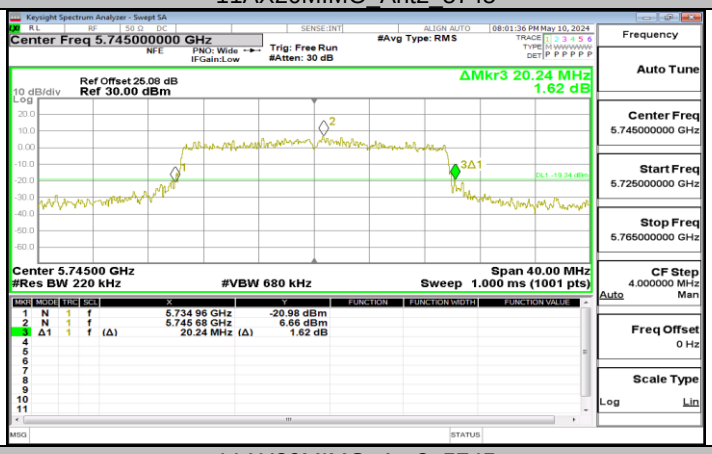

11AX20MIMO_Ant3_5745

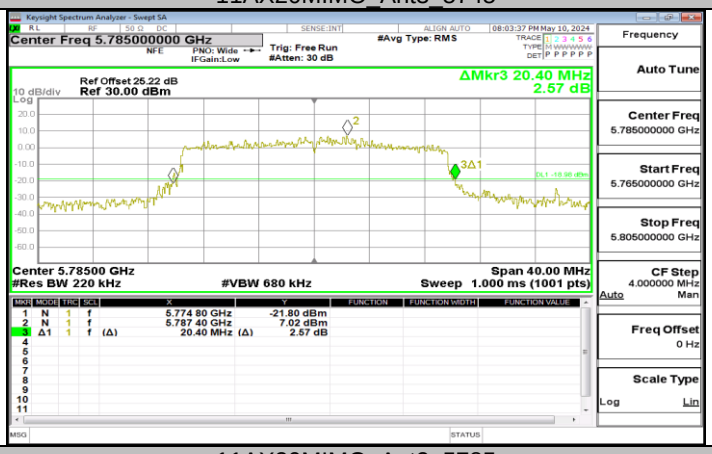

11AX20MIMO_Ant2_5785

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

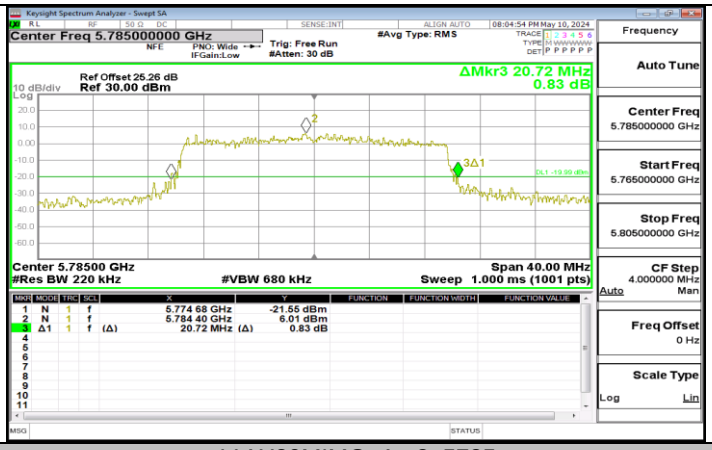

11AX20MIMO_Ant3_5785

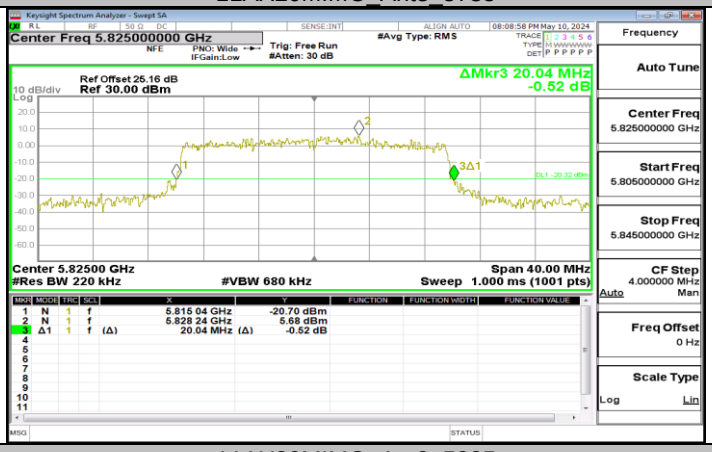

11AX20MIMO_Ant2_5825

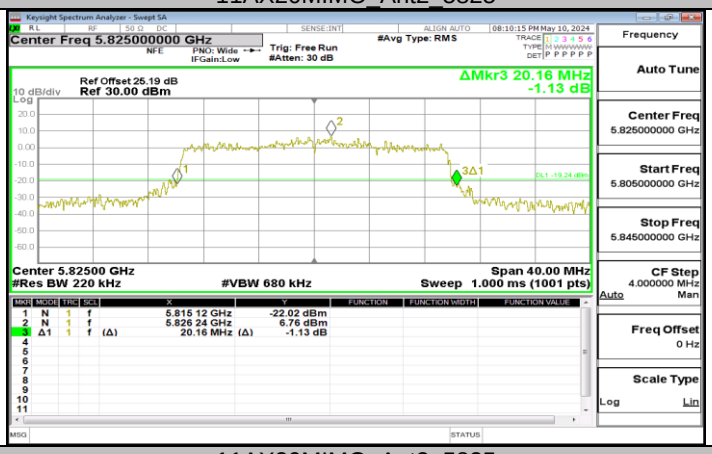

11AX20MIMO_Ant3_5825

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

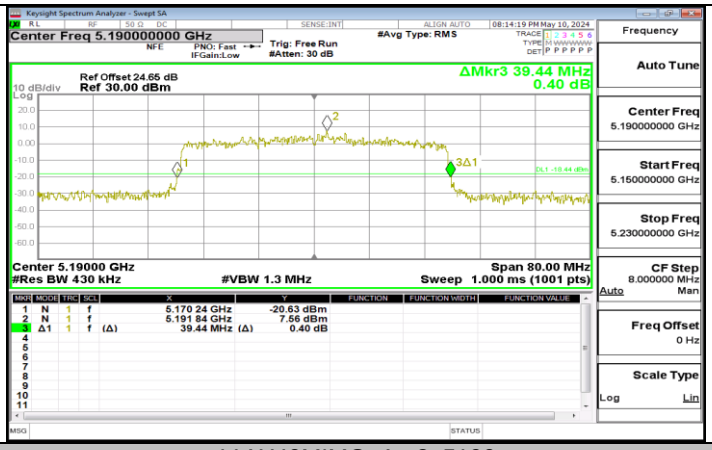

11AX40MIMO_Ant2_5190

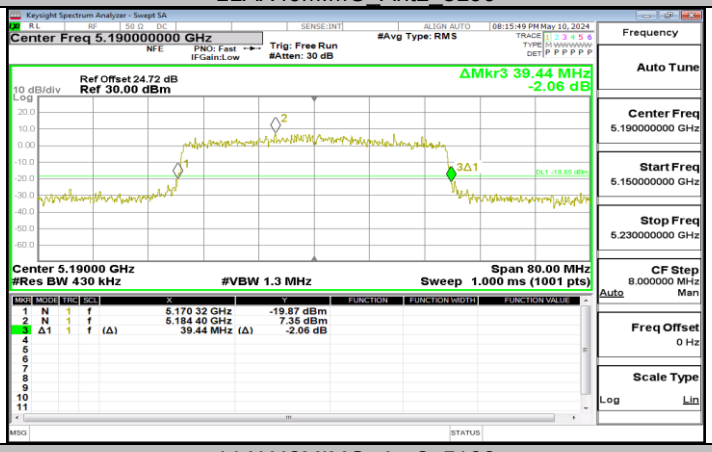

11AX40MIMO_Ant3_5190

11AX40MIMO_Ant2_5230

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

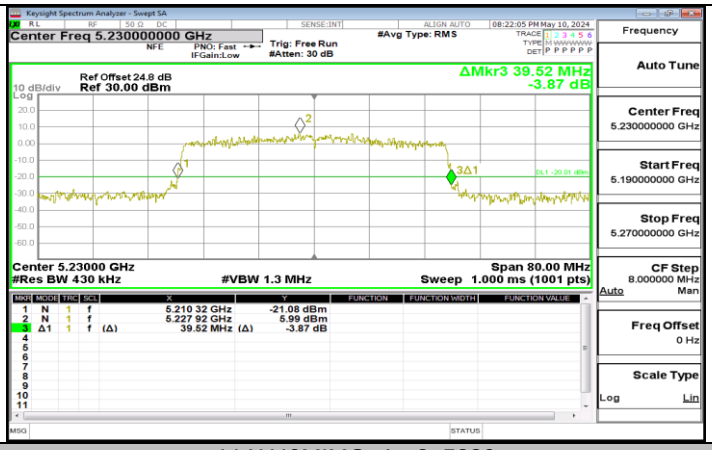

11AX40MIMO_Ant3_5230

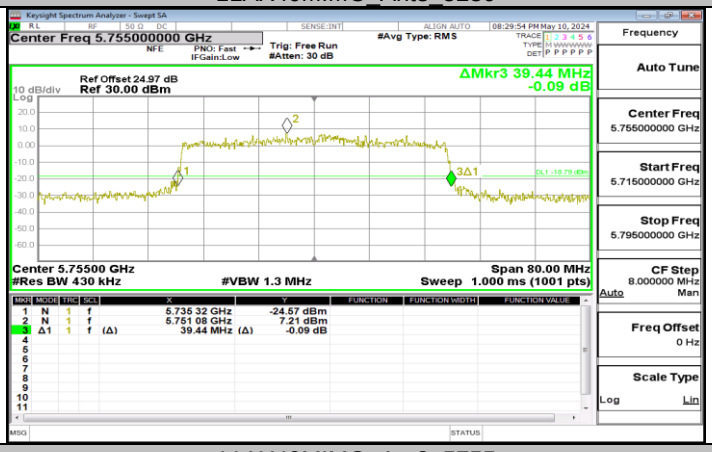

11AX40MIMO_Ant2_5755

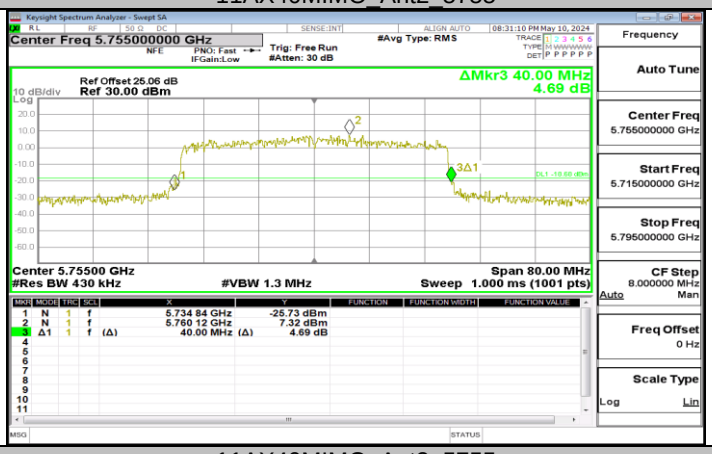

11AX40MIMO_Ant3_5755

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11AX40MIMO_Ant2_5795

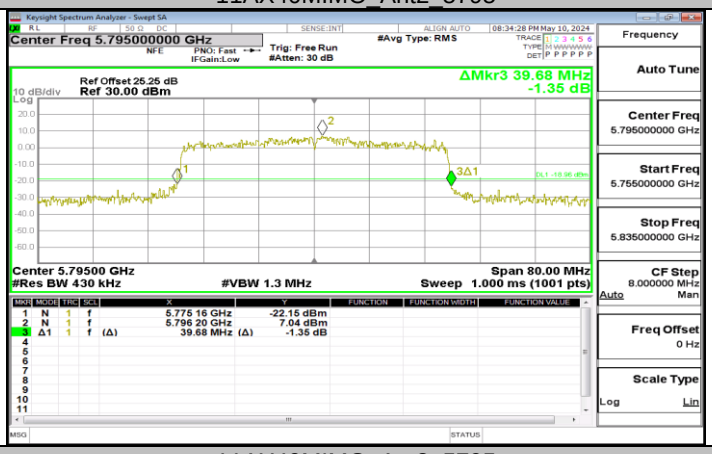

11AX40MIMO_Ant3_5795

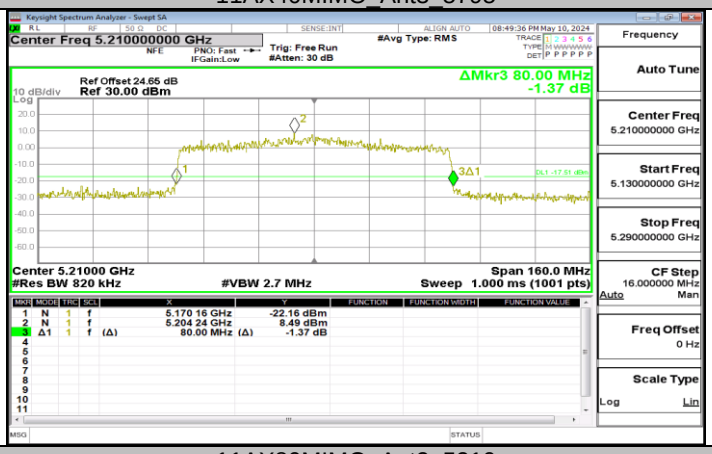

11AX80MIMO_Ant2_5210

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

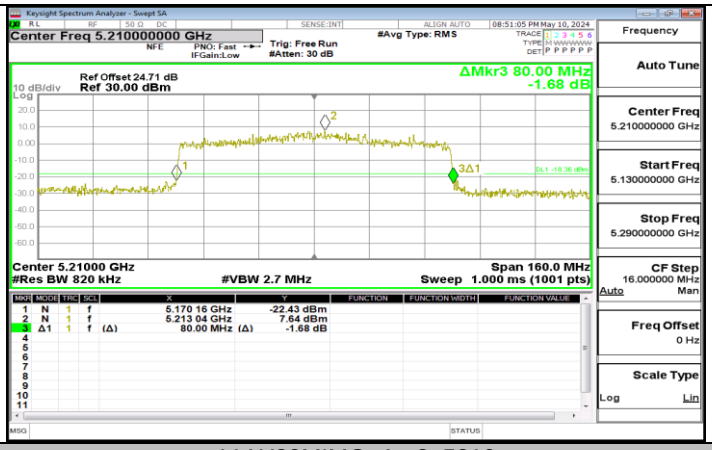

11AX80MIMO_Ant3_5210

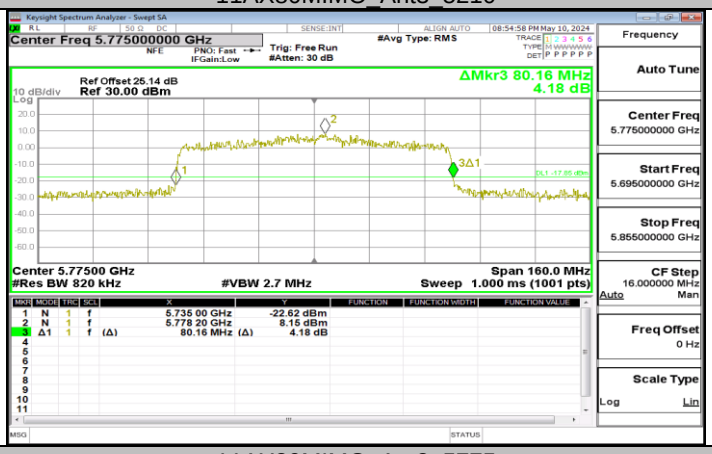

11AX80MIMO_Ant2_5775

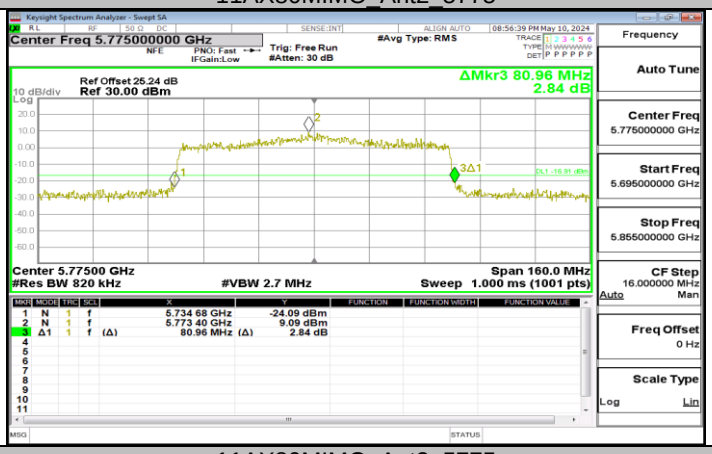

11AX80MIMO_Ant3_5775

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11.2. APPENDIX B: OCCUPIED CHANNEL BANDWIDTH

11.2.1. Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]
11A	Ant2	5180	16.348	5171.8682	5188.2162
	Ant3	5180	16.366	5171.8523	5188.2183
	Ant2	5200	16.378	5191.8357	5208.2137
	Ant3	5200	16.361	5191.8434	5208.2044
	Ant2	5240	16.412	5231.8264	5248.2384
	Ant3	5240	16.385	5231.8185	5248.2035
	Ant2	5745	16.419	5736.8278	5753.2468
	Ant3	5745	16.366	5736.8446	5753.2106
	Ant2	5785	16.349	5776.8654	5793.2144
	Ant3	5785	16.398	5776.8301	5793.2281
	Ant2	5825	16.414	5816.8116	5833.2256
	Ant3	5825	16.392	5816.8296	5833.2216
11N20MIMO	Ant2	5180	17.582	5171.2128	5188.7948
	Ant3	5180	17.611	5171.1832	5188.7942
	Ant2	5200	17.607	5191.2051	5208.8121
	Ant3	5200	17.671	5191.1732	5208.8442
	Ant2	5240	17.655	5231.2172	5248.8722
	Ant3	5240	17.616	5231.2453	5248.8613
	Ant2	5745	17.575	5736.2345	5753.8095
	Ant3	5745	17.638	5736.2079	5753.8459
	Ant2	5785	17.593	5776.2078	5793.8008
	Ant3	5785	17.636	5776.2244	5793.8604
	Ant2	5825	17.642	5816.1769	5833.8189
	Ant3	5825	17.646	5816.1873	5833.8333
11N40MIMO	Ant2	5190	36.026	5172.0690	5208.0950
	Ant3	5190	36.079	5172.0189	5208.0979
	Ant2	5230	36.083	5211.9964	5248.0794
	Ant3	5230	36.071	5212.0109	5248.0819
	Ant2	5755	36.087	5737.0051	5773.0921
	Ant3	5755	36.093	5737.0134	5773.1064
	Ant2	5795	35.938	5777.0430	5812.9810
	Ant3	5795	36.102	5777.0068	5813.1088
11AC80MIMO	Ant2	5210	75.450	5172.3201	5247.7701
	Ant3	5210	75.350	5172.4182	5247.7682
	Ant2	5775	75.382	5737.3958	5812.7778
	Ant3	5775	75.051	5737.6631	5812.7141
11AX20MIMO	Ant2	5180	18.842	5170.6250	5189.4670
	Ant3	5180	18.875	5170.6006	5189.4756
	Ant2	5200	18.966	5190.5006	5209.4666
	Ant3	5200	18.894	5190.5497	5209.4437
	Ant2	5240	18.902	5230.5820	5249.4840
	Ant3	5240	18.875	5230.6000	5249.4750
	Ant2	5745	18.854	5735.6092	5754.4632
	Ant3	5745	18.921	5735.5753	5754.4963
	Ant2	5785	18.919	5775.5666	5794.4856
	Ant3	5785	18.886	5775.5830	5794.4690
	Ant2	5825	18.880	5815.6187	5834.4987
	Ant3	5825	18.886	5815.5613	5834.4473
11AX40MIMO	Ant2	5190	37.626	5171.1996	5208.8256
	Ant3	5190	37.724	5171.1832	5208.9072
	Ant2	5230	37.617	5211.2003	5248.8173
	Ant3	5230	37.647	5211.2055	5248.8525
	Ant2	5755	37.730	5736.2016	5773.9316

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

	Ant3	5755	37.721	5736.1678	5773.8888
	Ant2	5795	37.562	5776.2966	5813.8586
	Ant3	5795	37.687	5776.2007	5813.8877
11AX80MIMO	Ant2	5210	76.846	5171.6346	5248.4806
	Ant3	5210	76.724	5171.7195	5248.4435
	Ant2	5775	76.857	5736.6768	5813.5338
	Ant3	5775	76.605	5736.9303	5813.5353

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11.2.2. Test Graphs

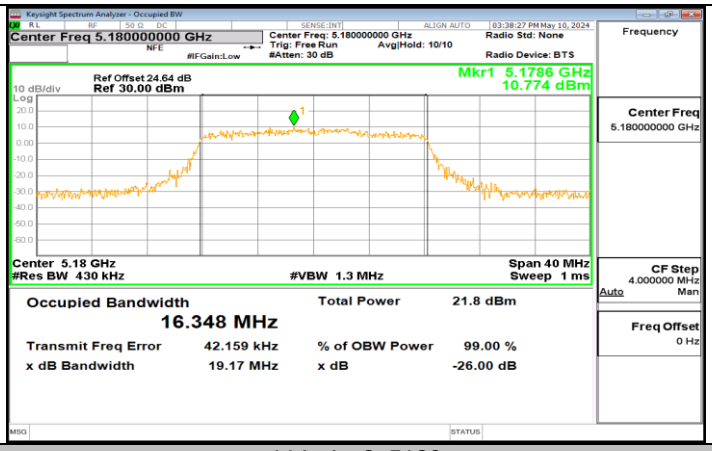

11A_Ant2_5180

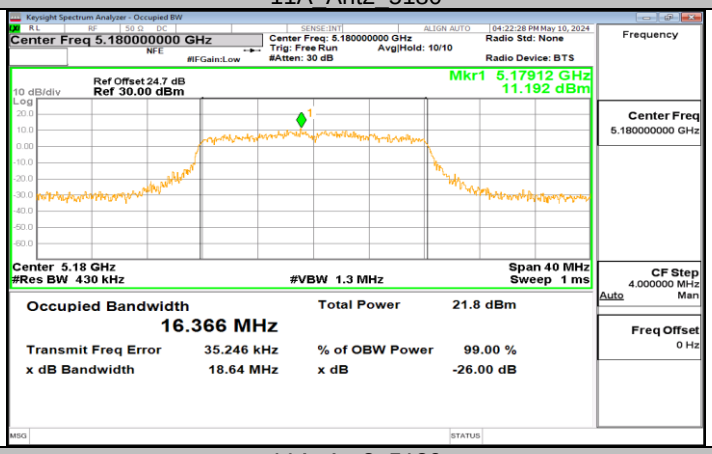

11A_Ant3_5180

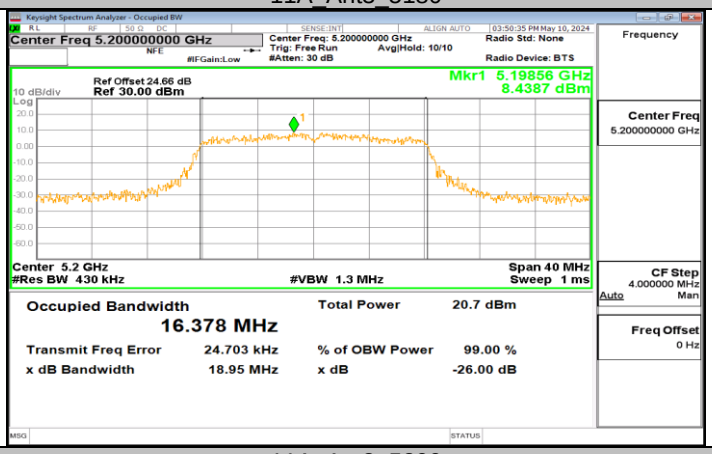

11A_Ant2_5200

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

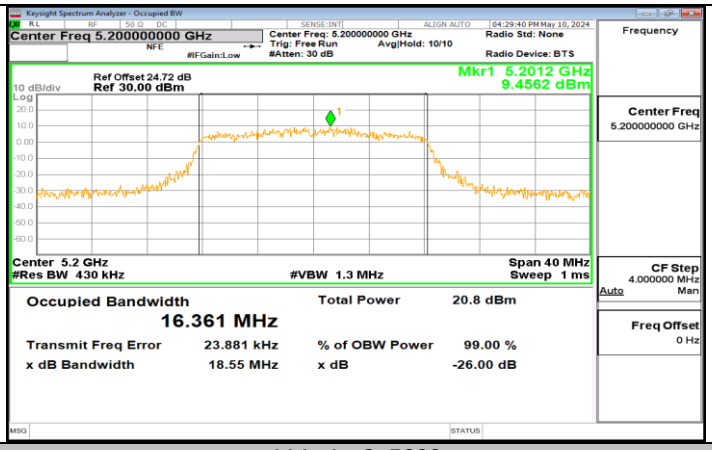

11A_Ant3_5200

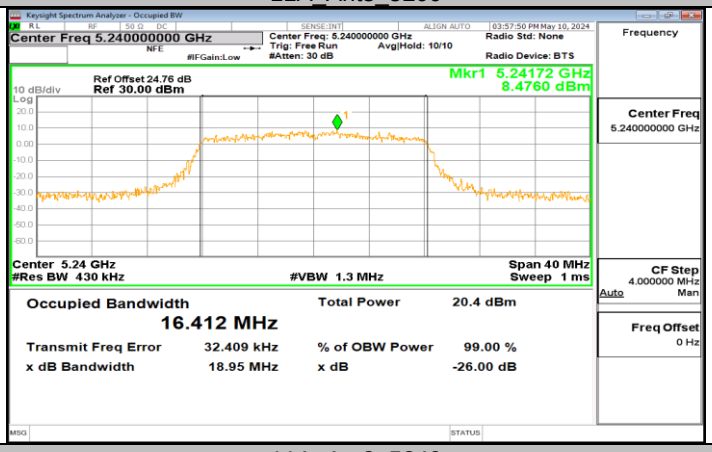

11A_Ant2_5240

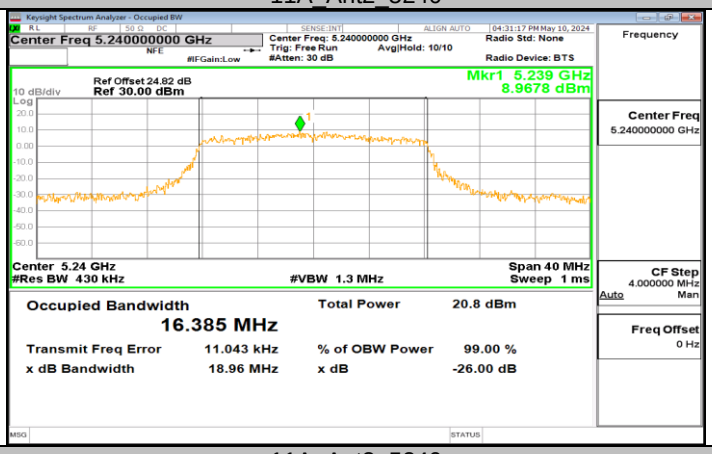

11A_Ant3_5240

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

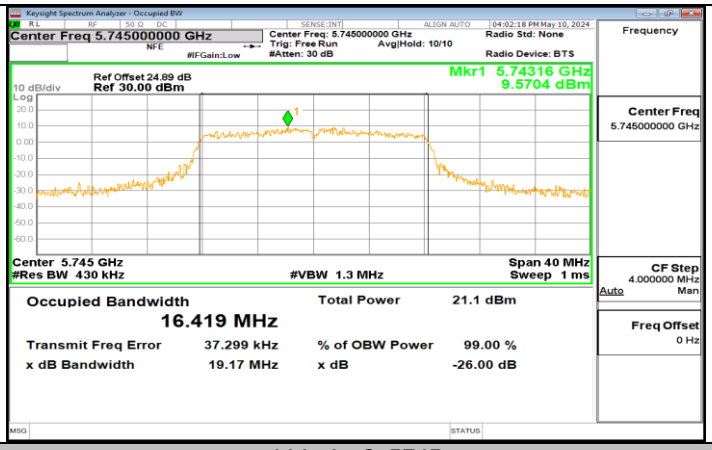

11A_Ant2_5745

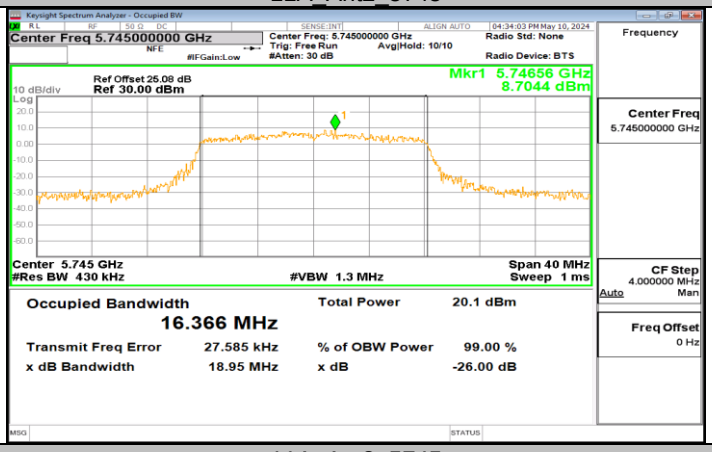

11A_Ant3_5745

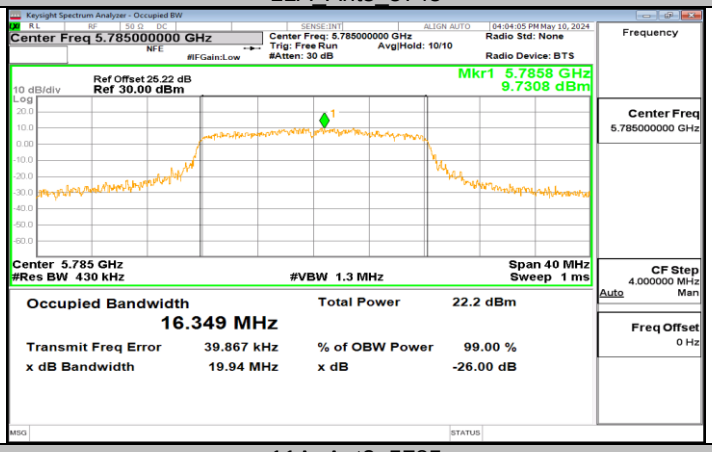

11A_Ant2_5785

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

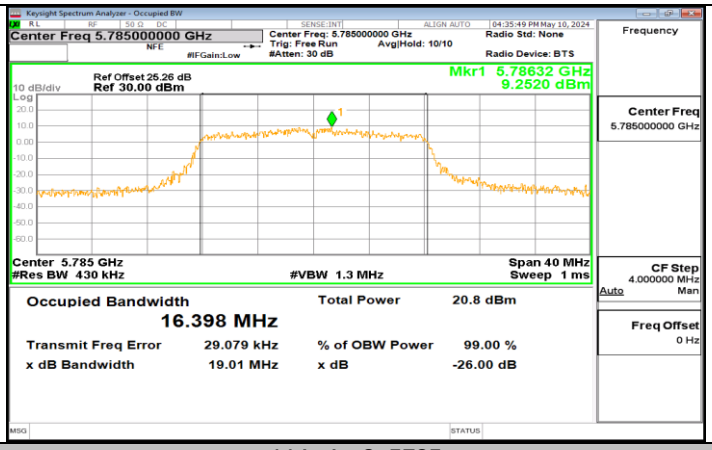

11A_Ant3_5785

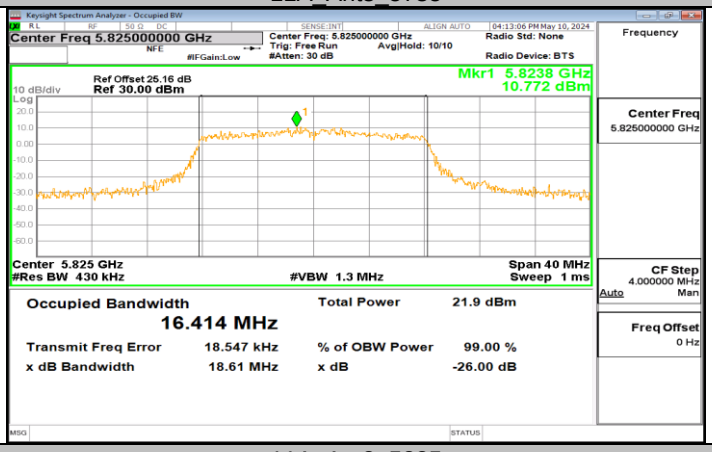

11A_Ant2_5825

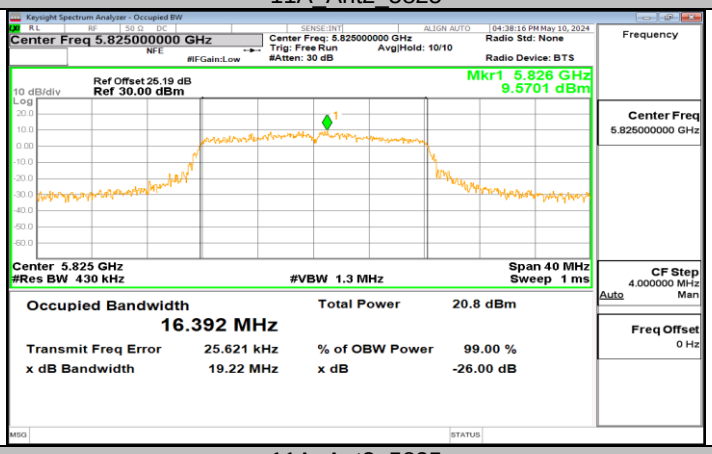

11A_Ant3_5825

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

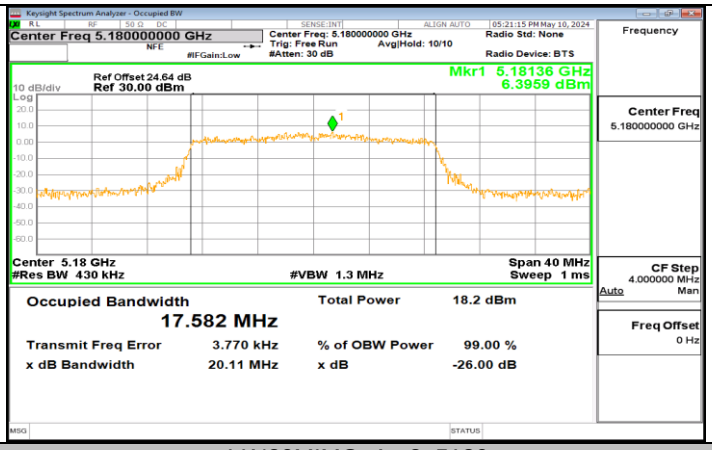

11N20MIMO_Ant2_5180

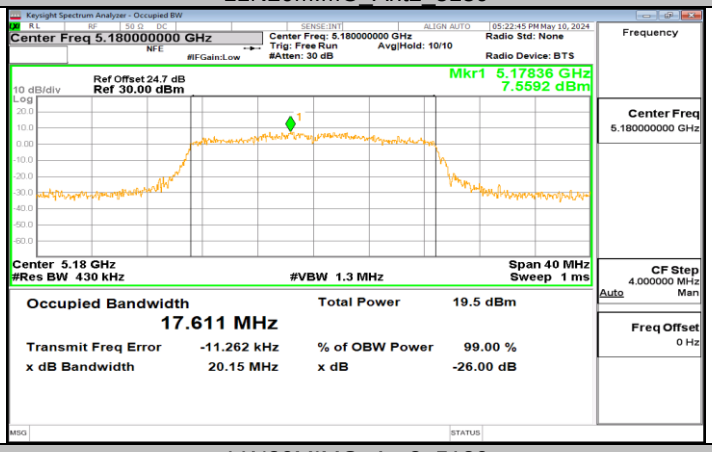

11N20MIMO_Ant3_5180

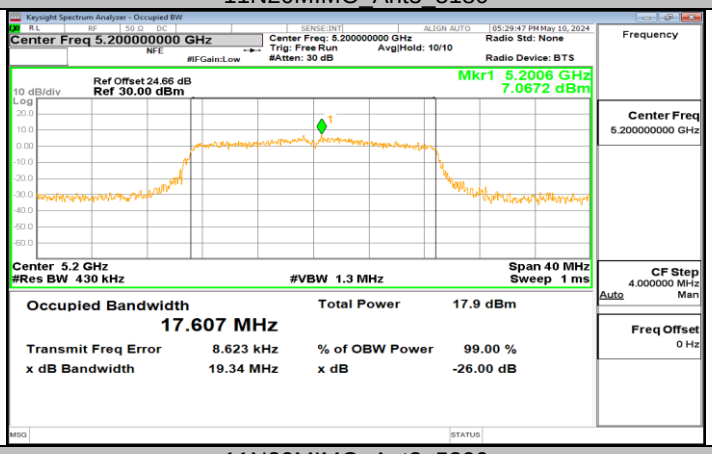

11N20MIMO_Ant2_5200

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

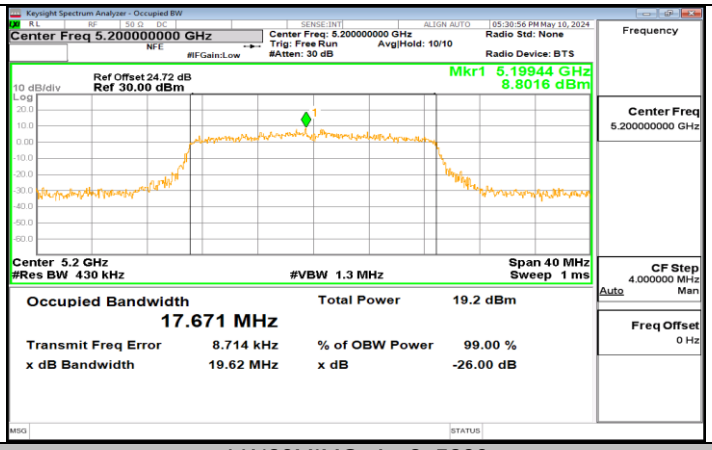

11N20MIMO_Ant3_5200

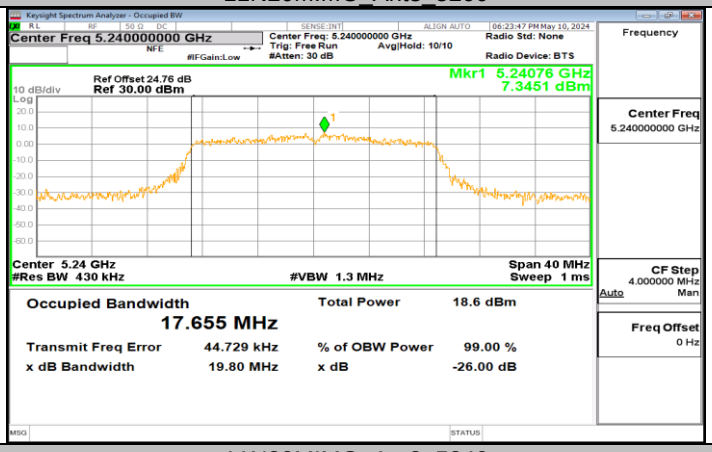

11N20MIMO_Ant2_5240

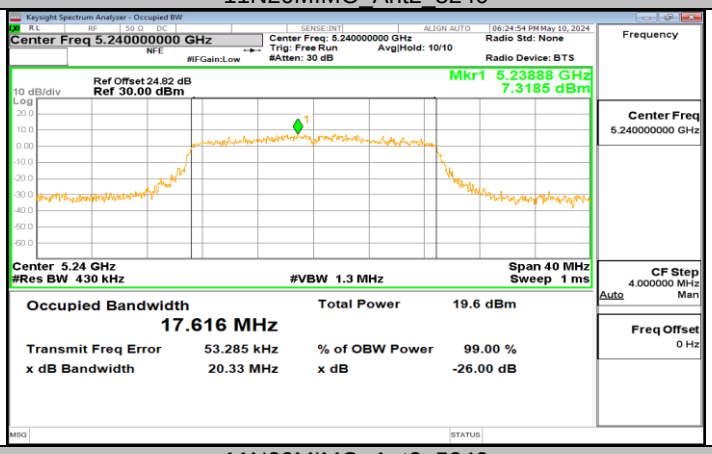

11N20MIMO_Ant3_5240

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.