




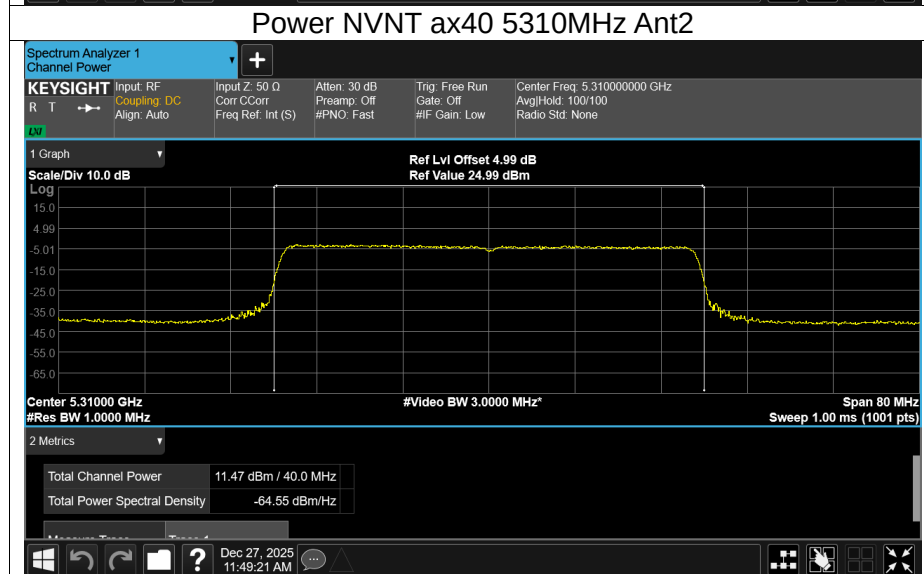
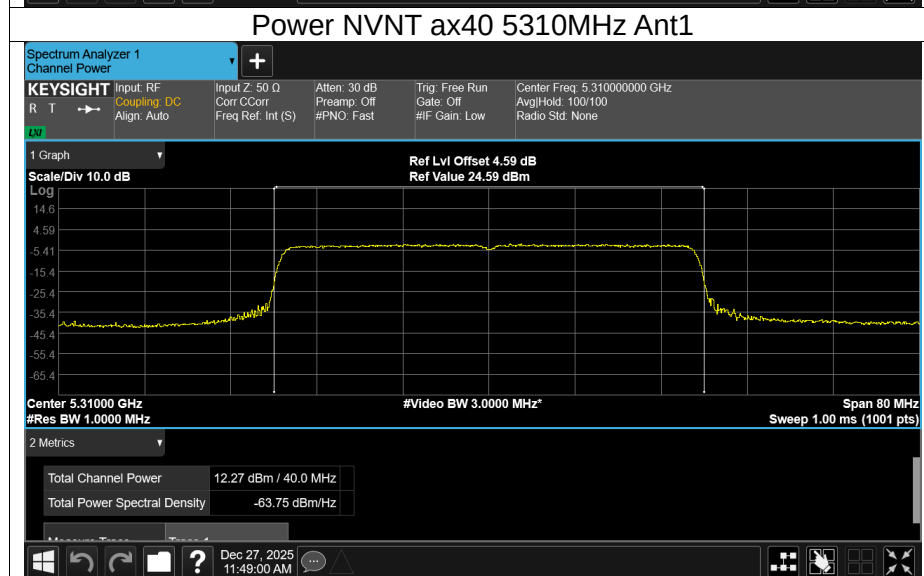
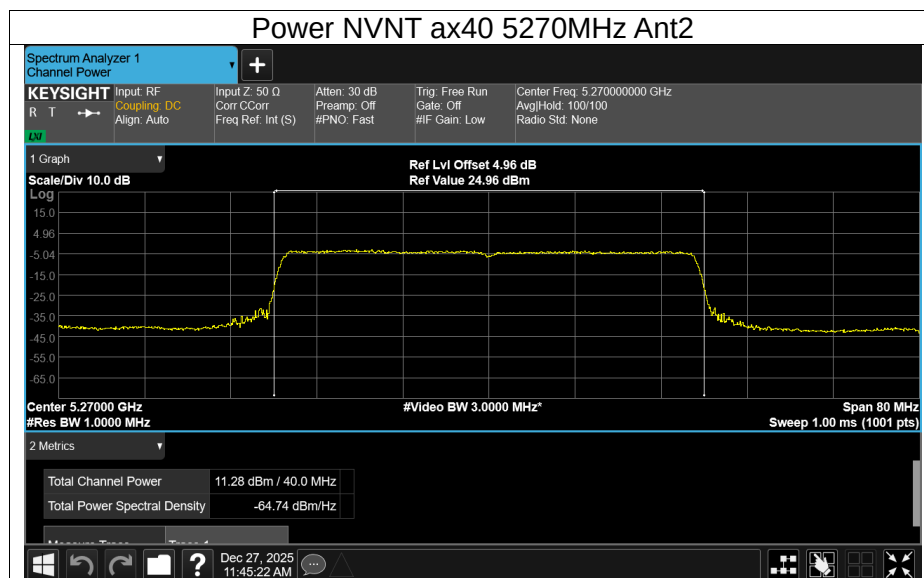
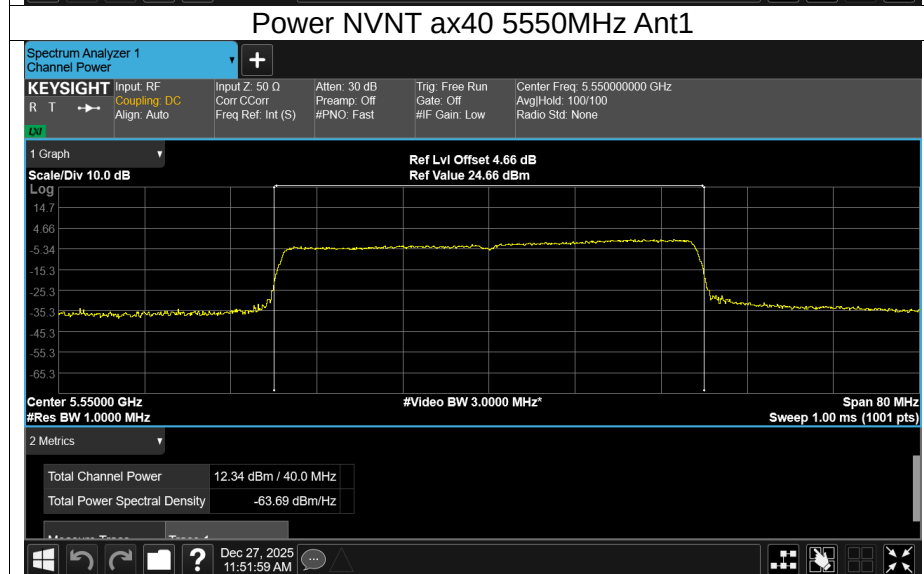
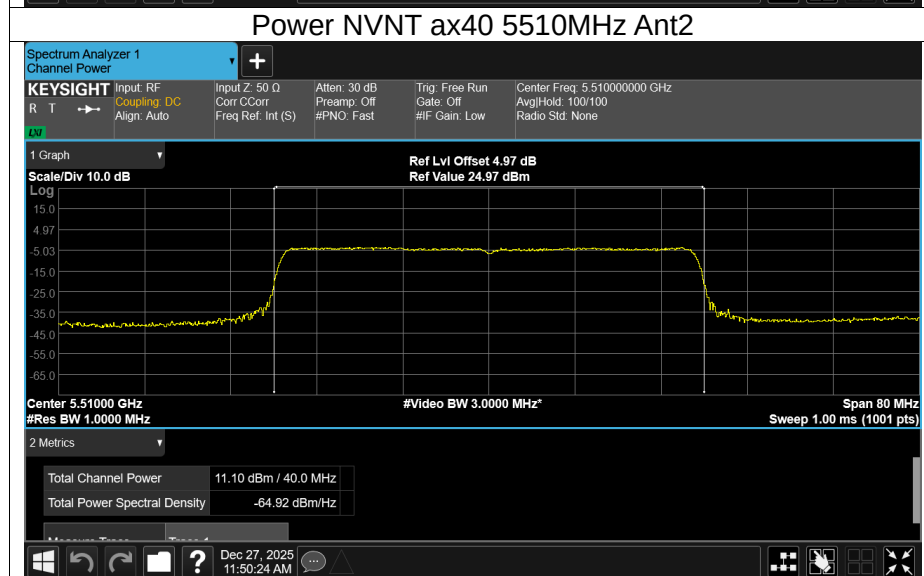
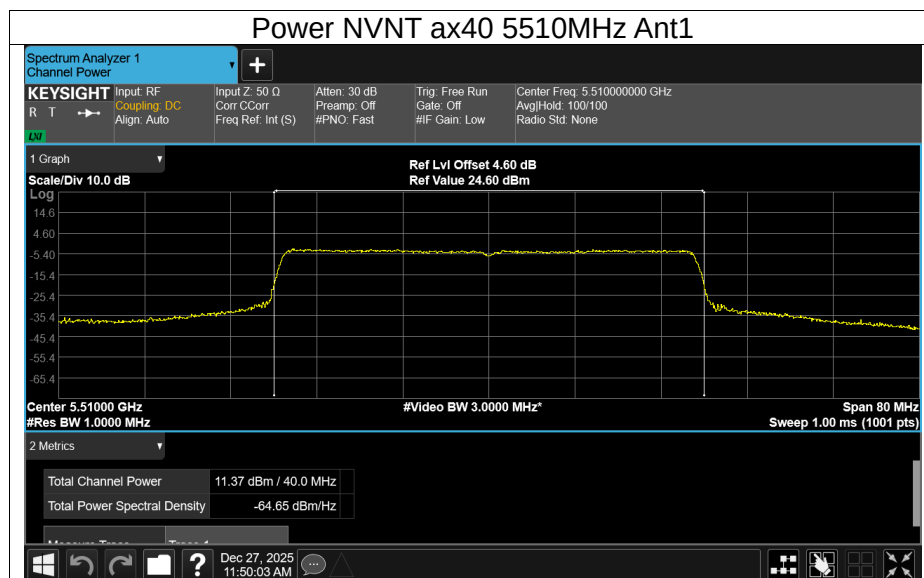
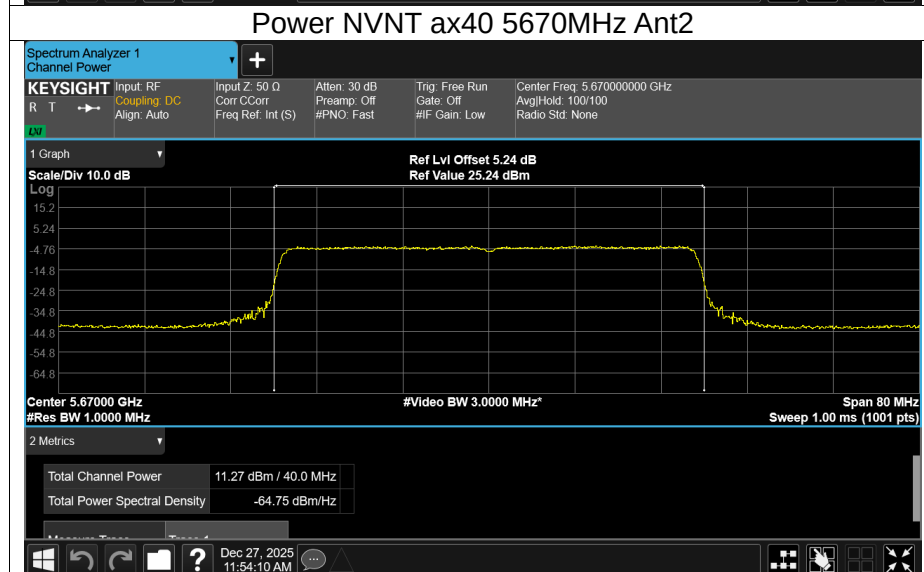
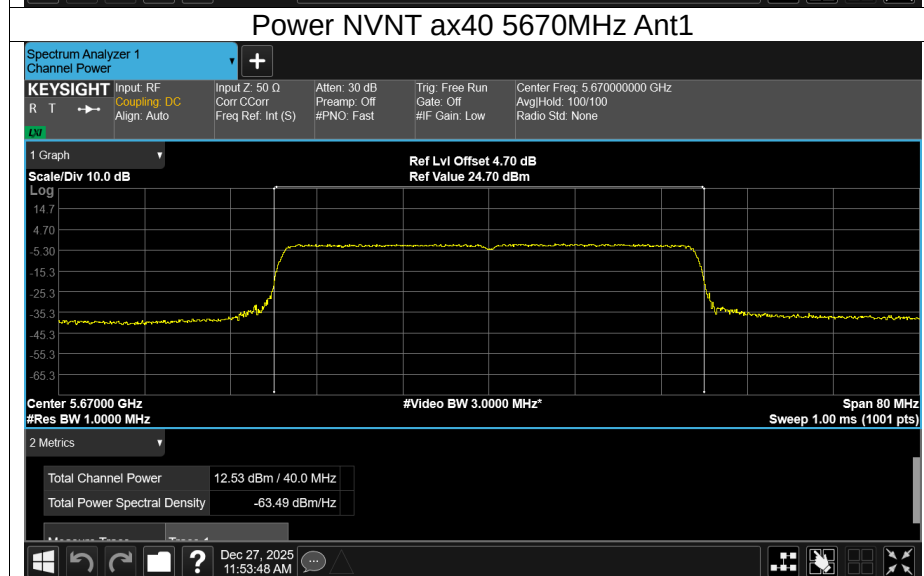
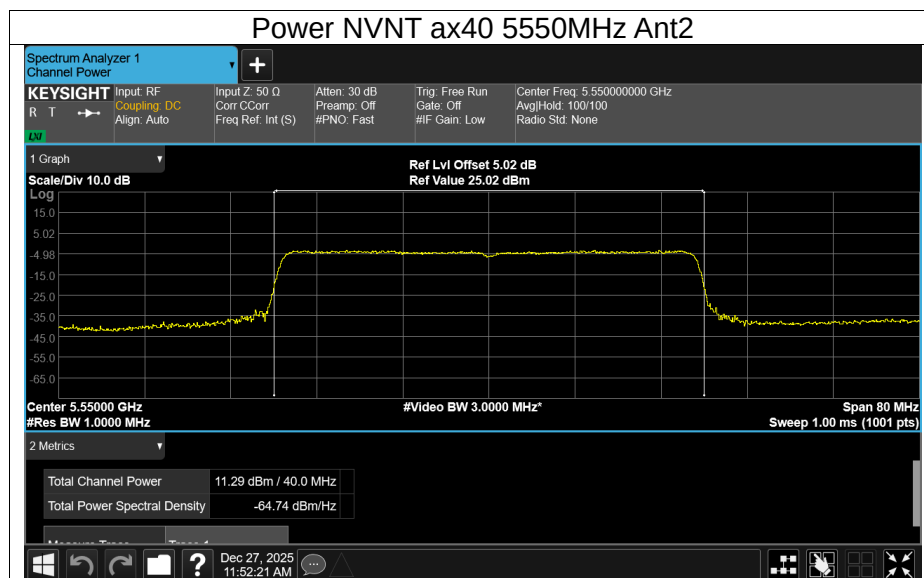
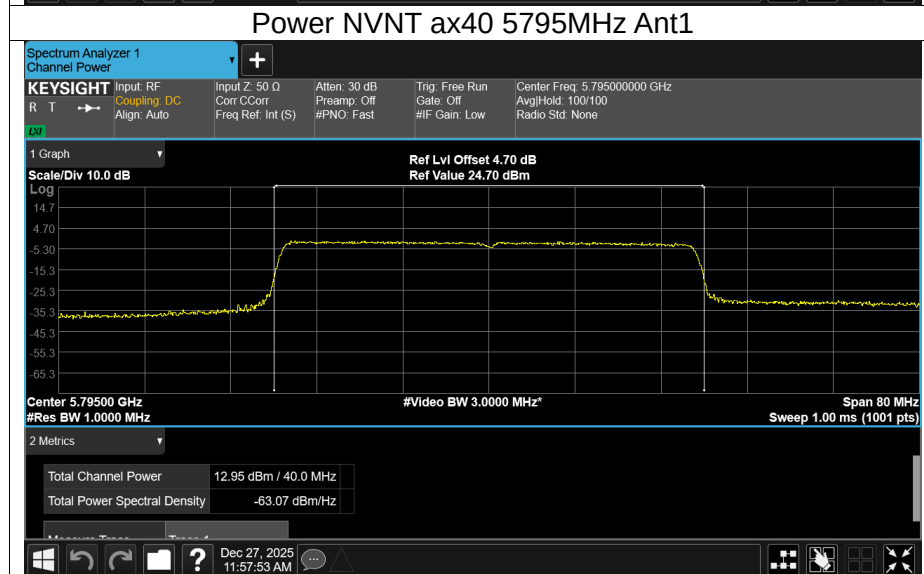




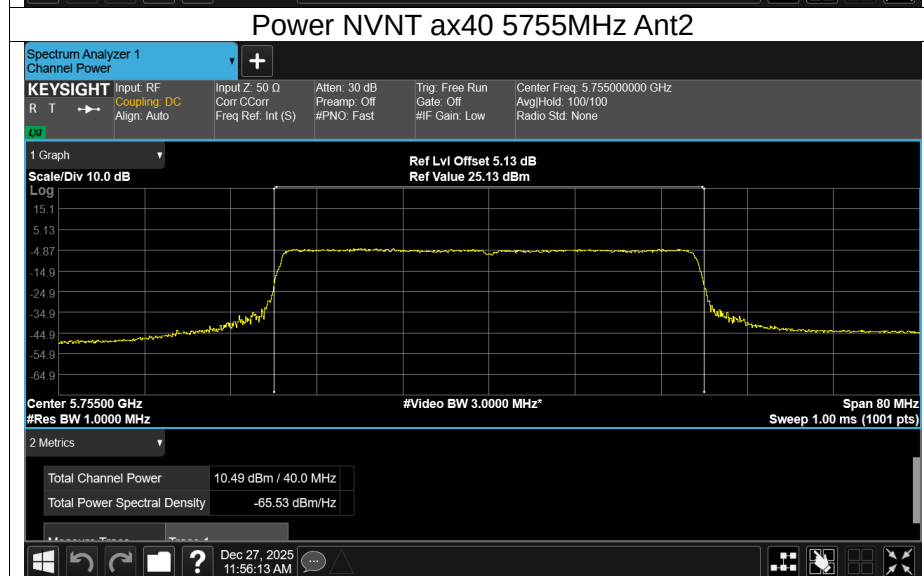




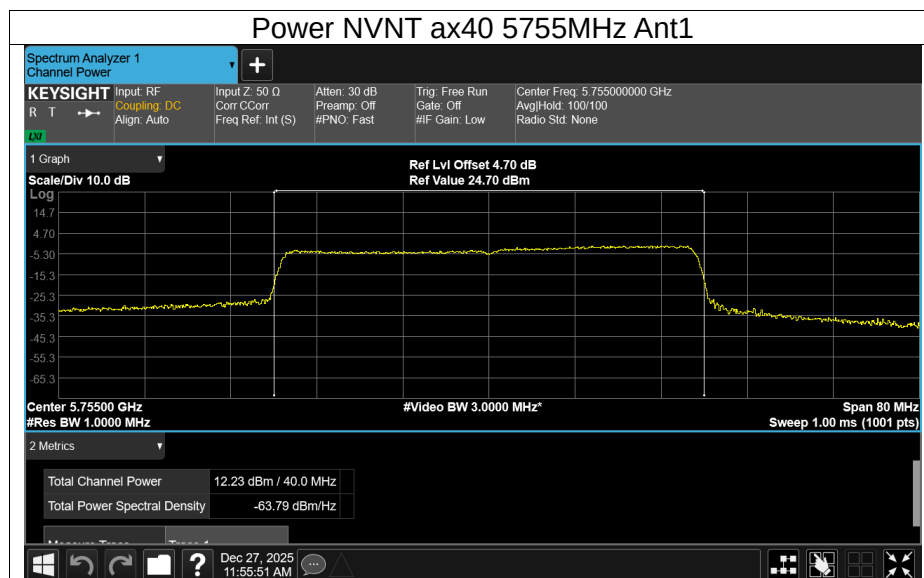




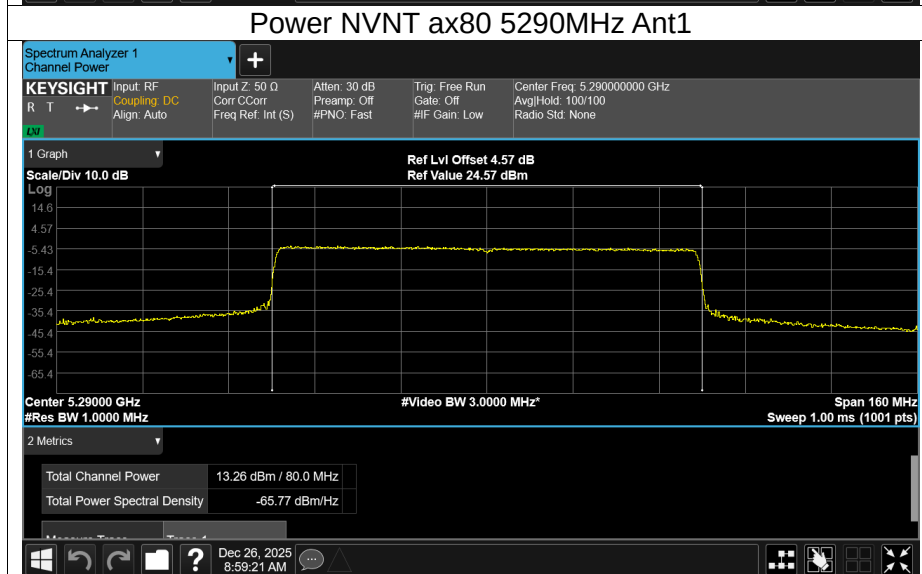




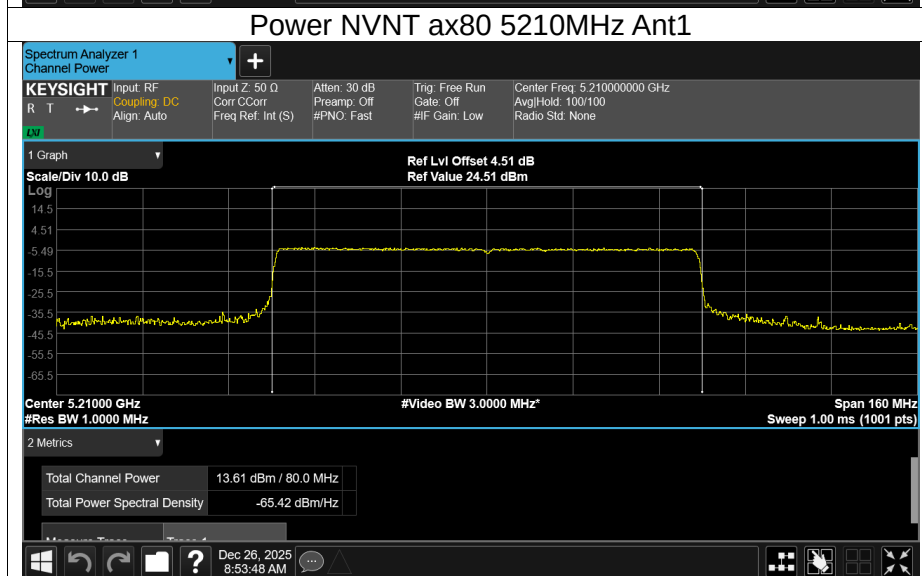




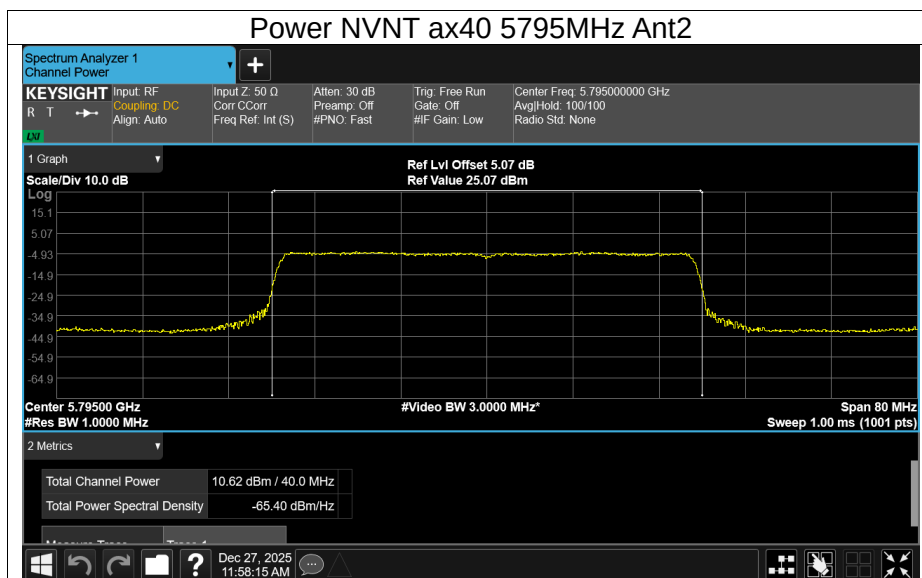


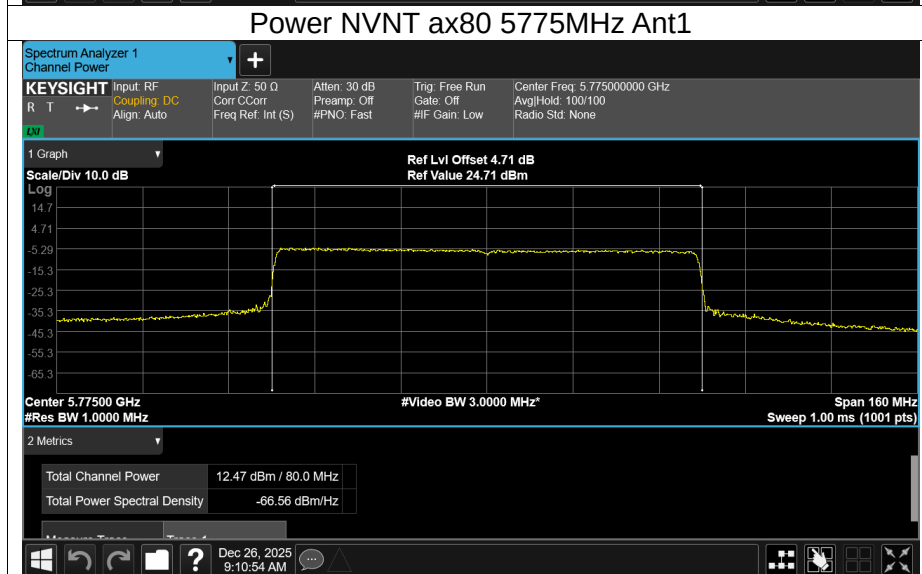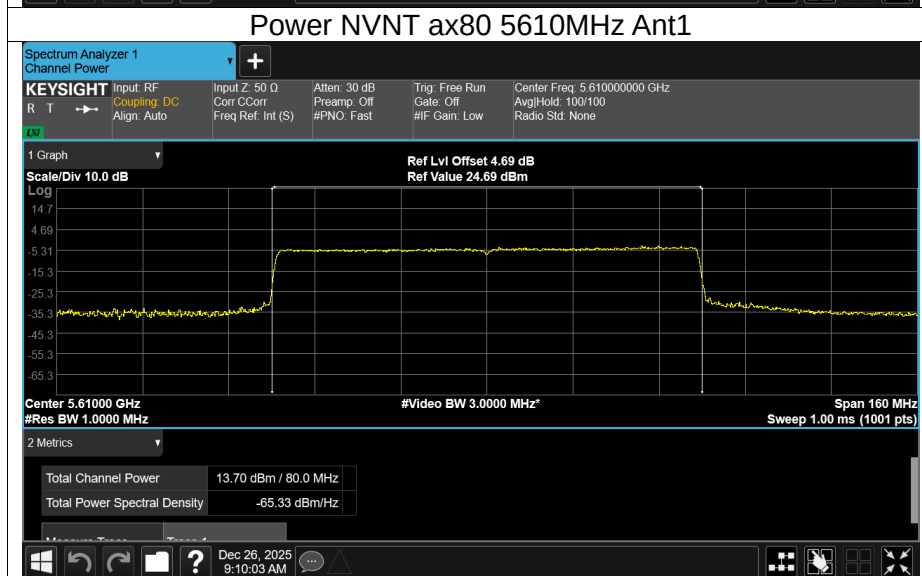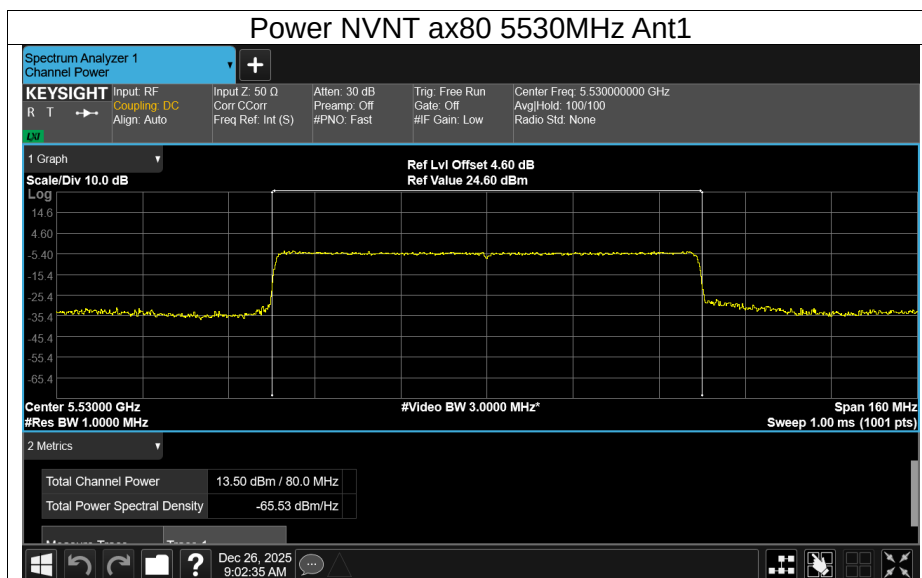


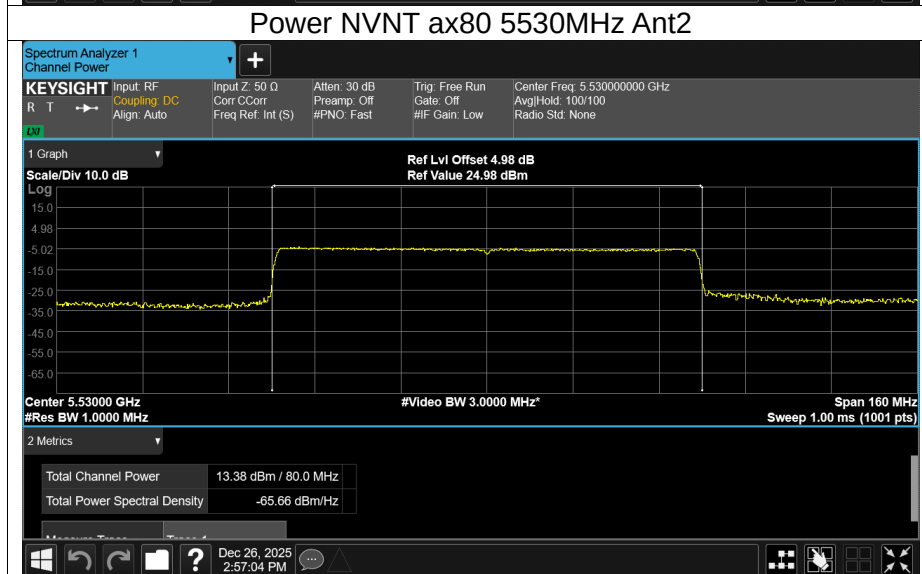
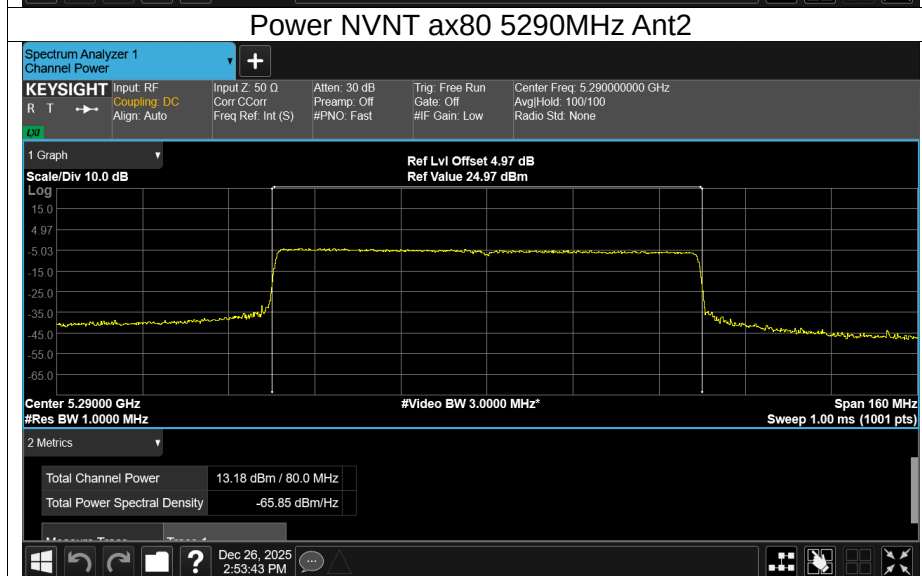
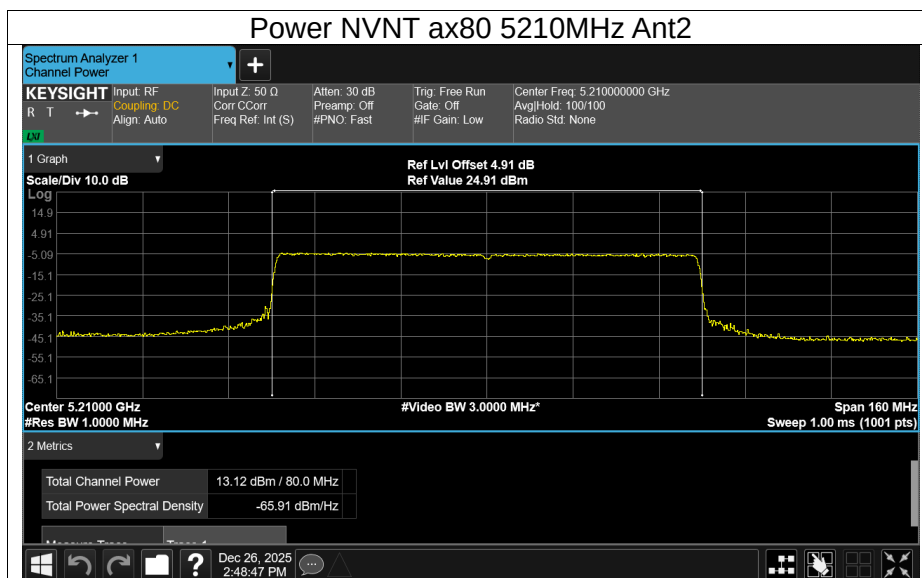


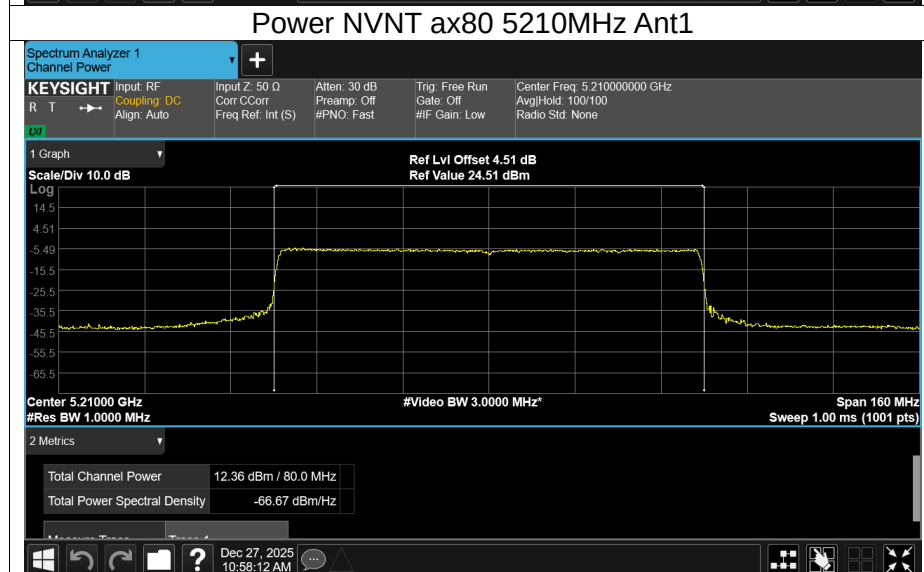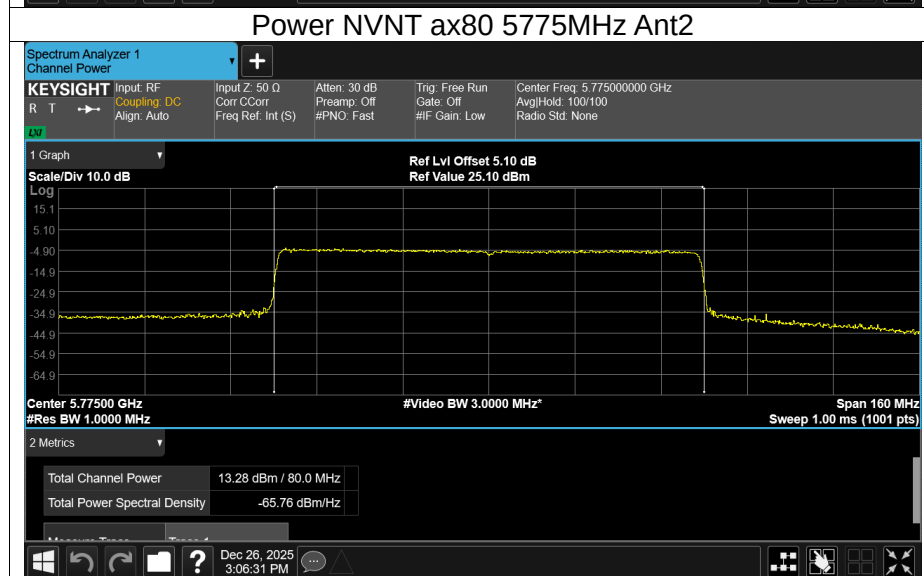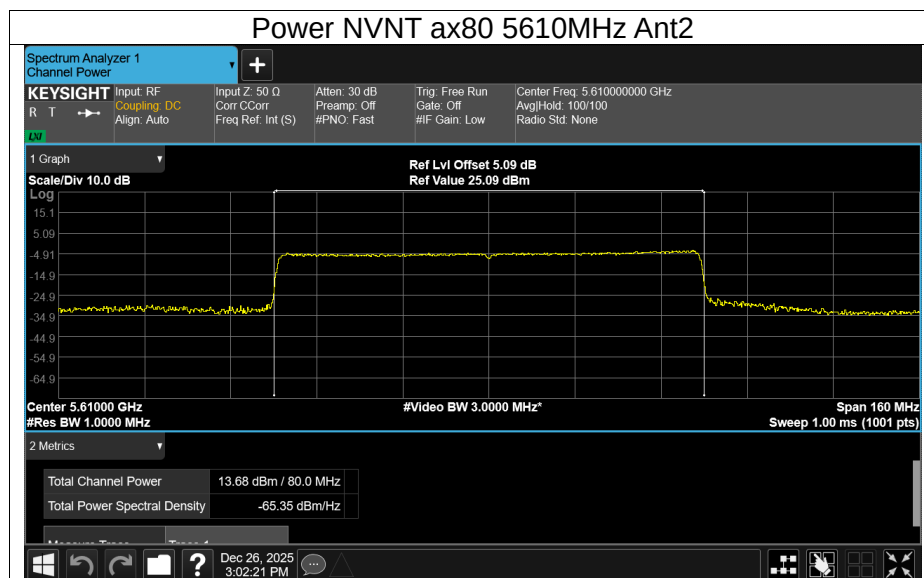


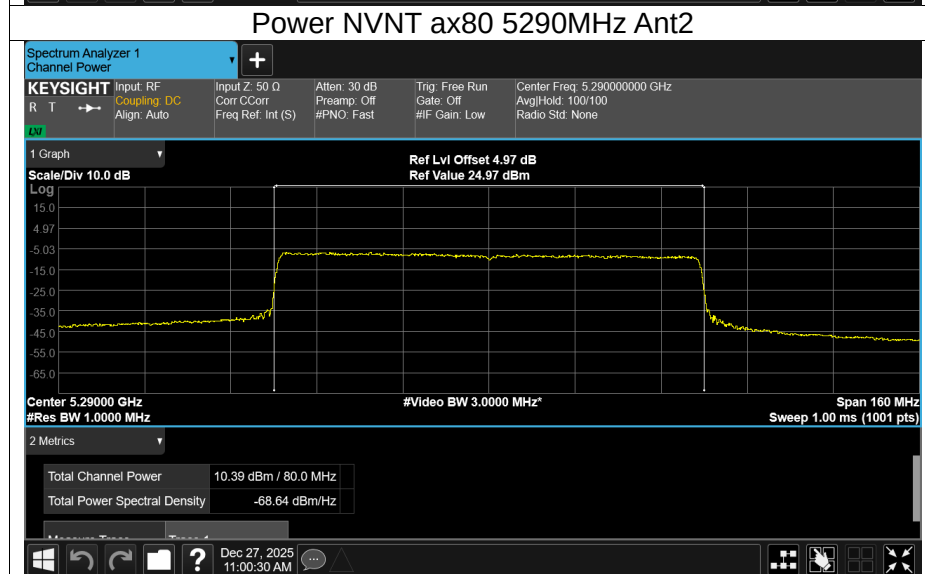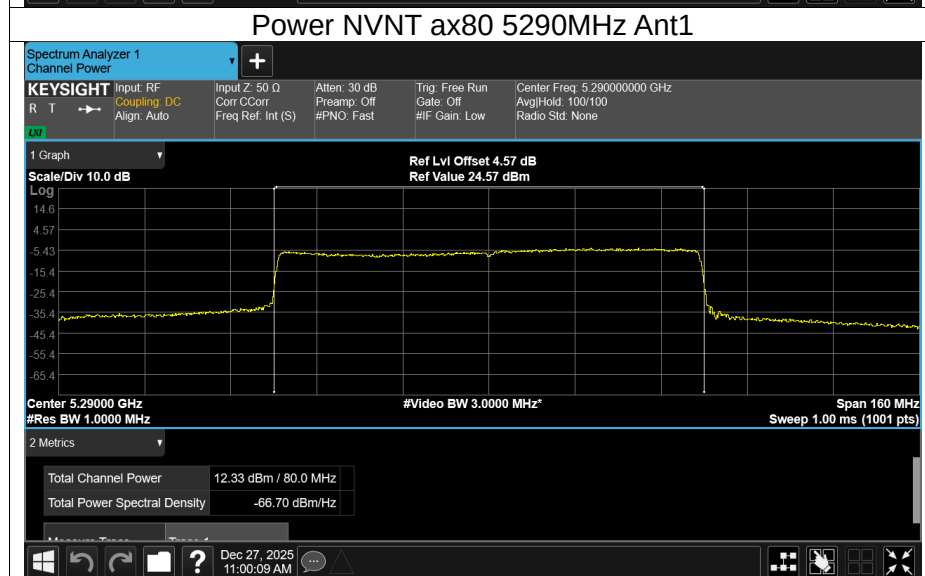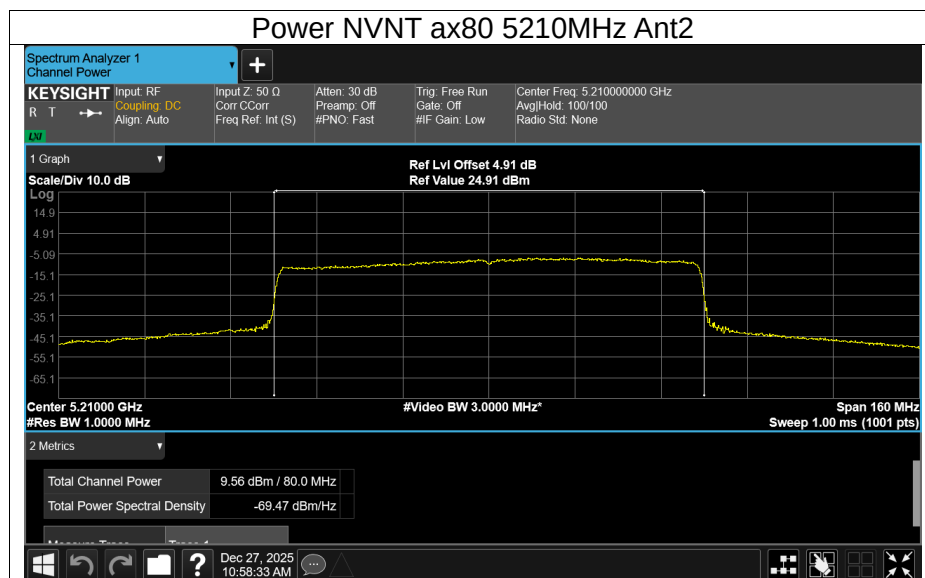


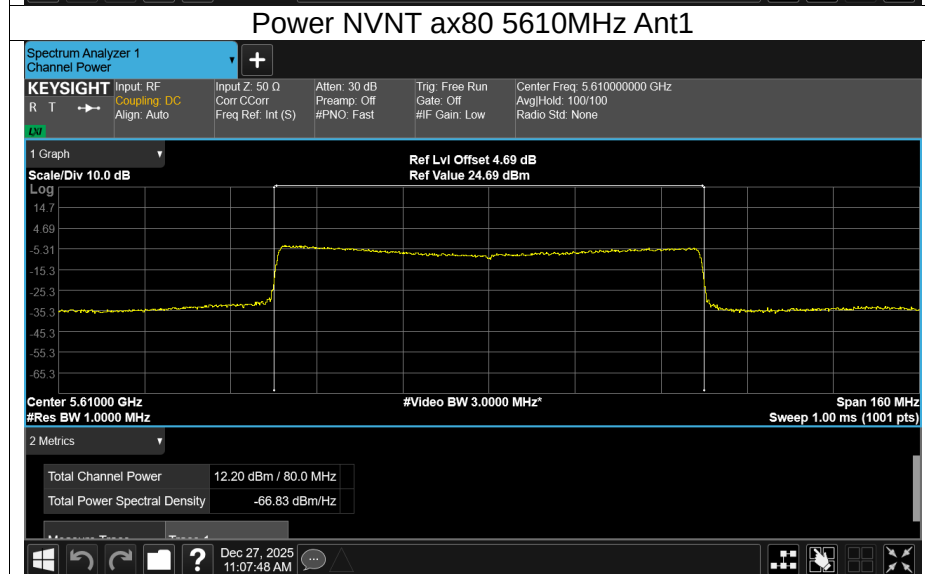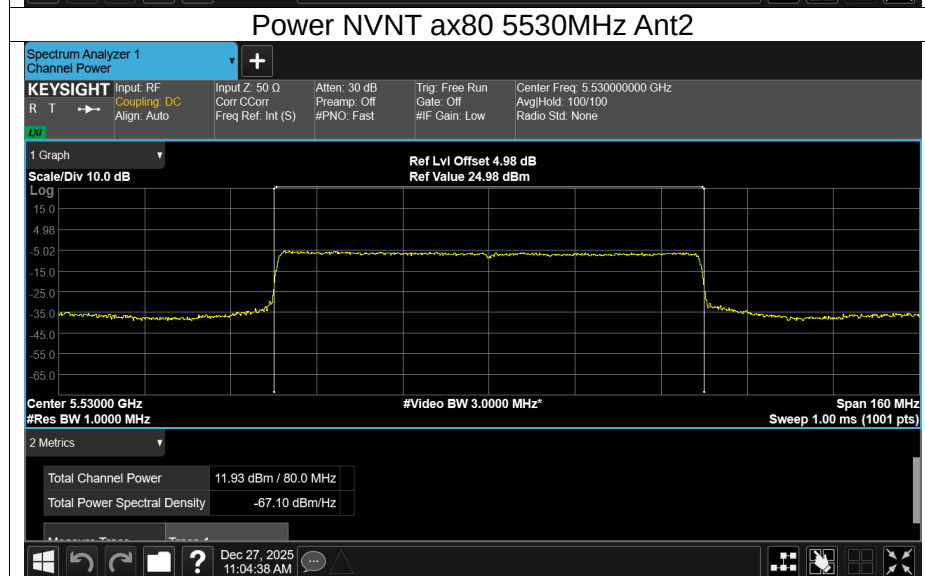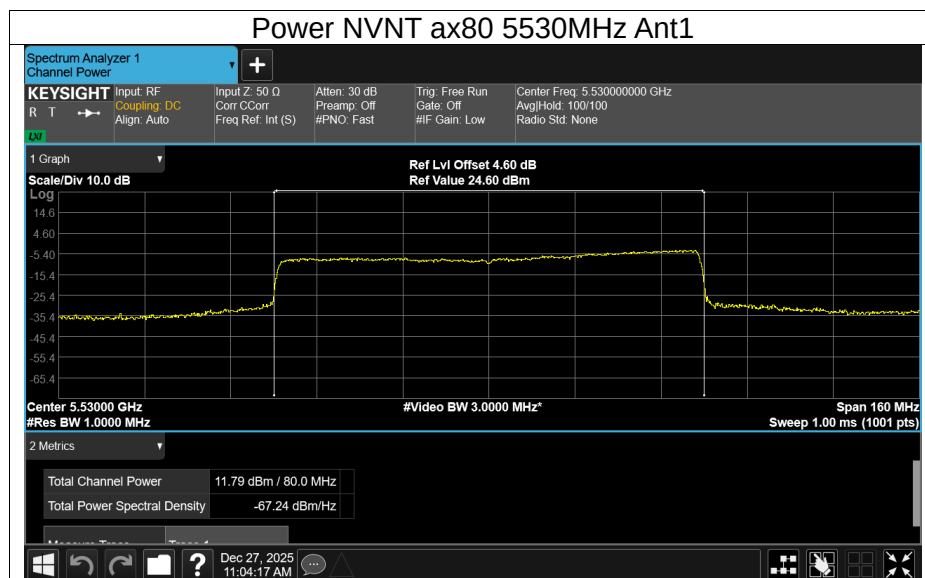

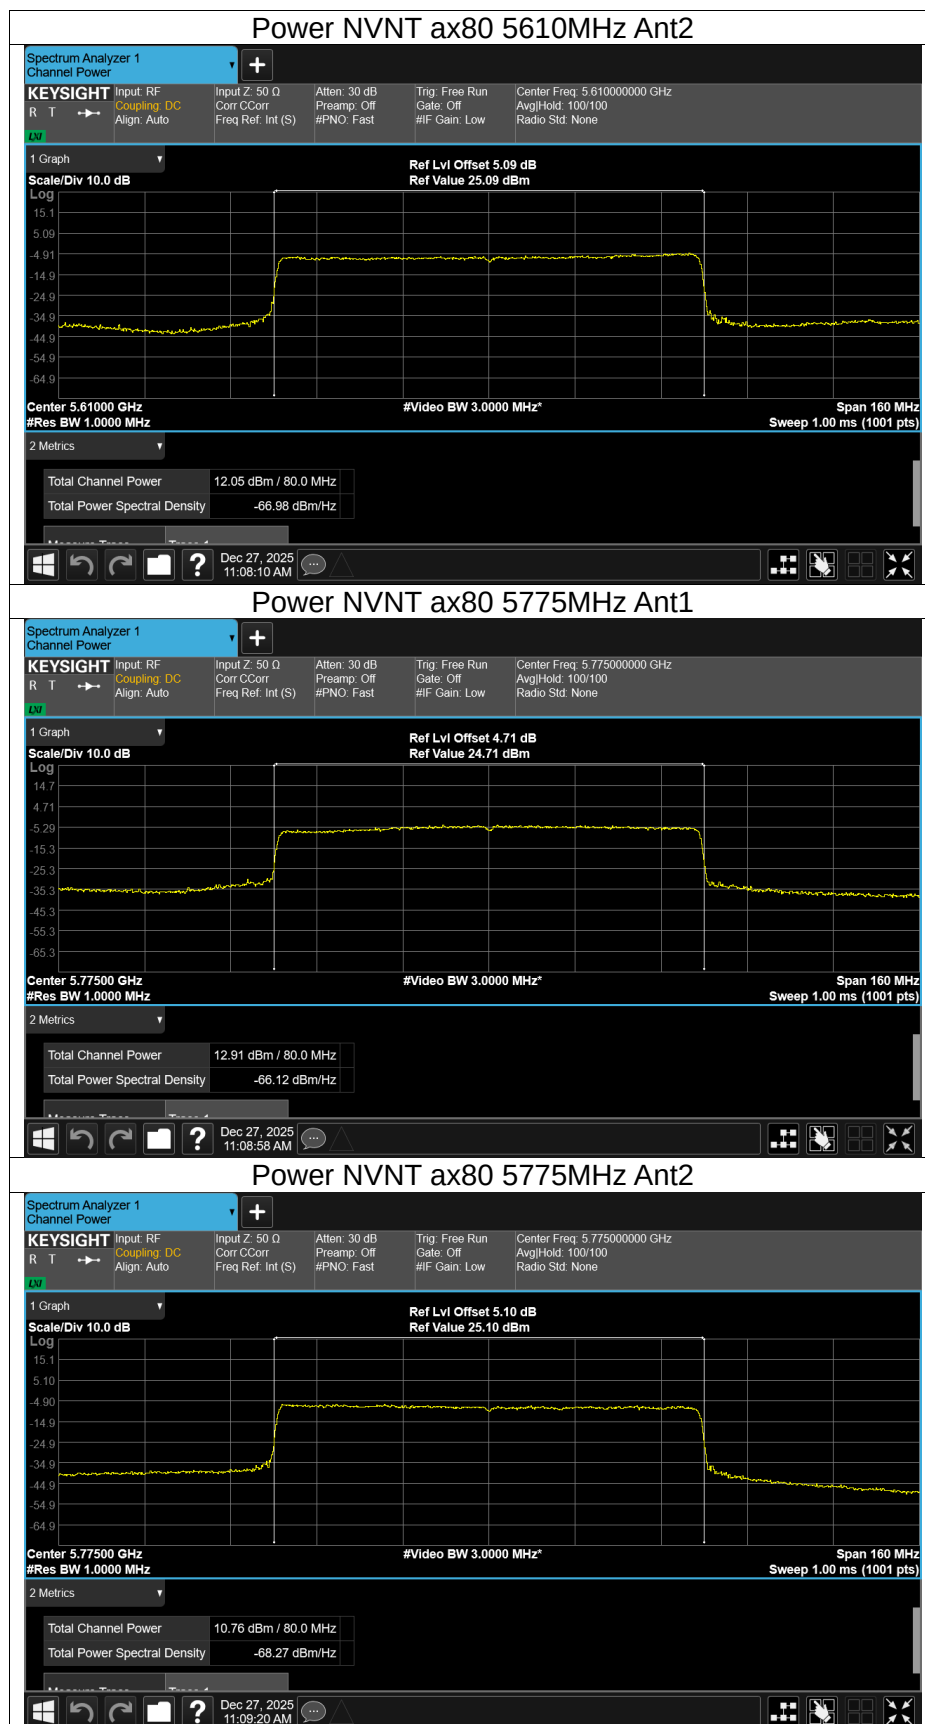

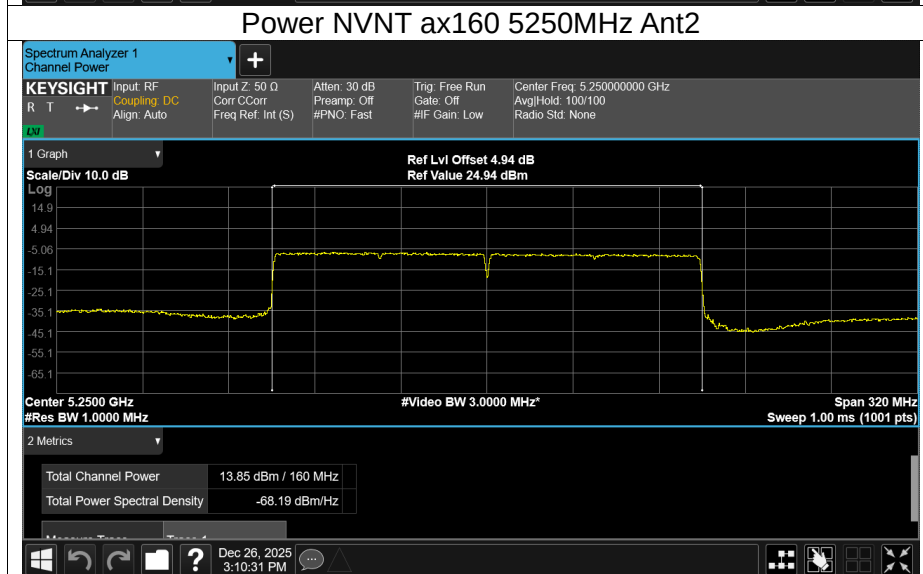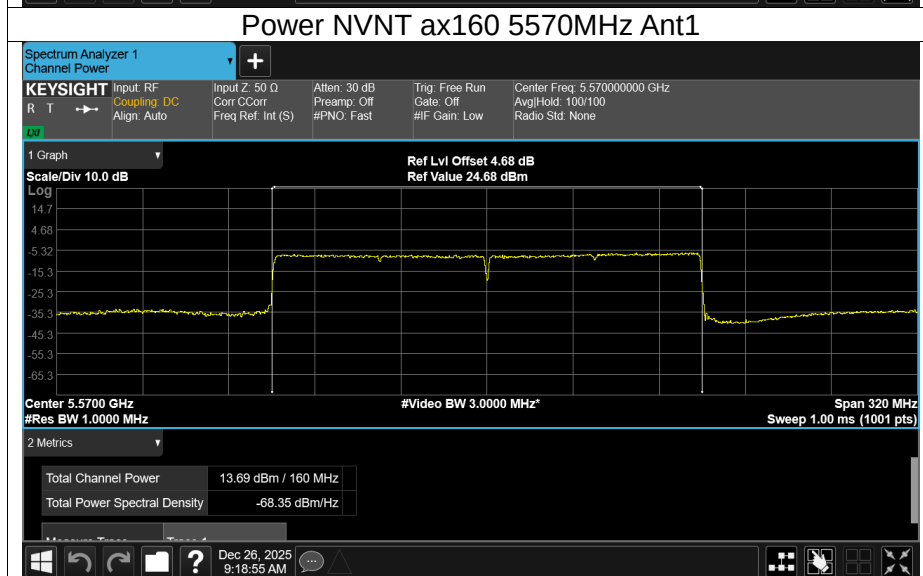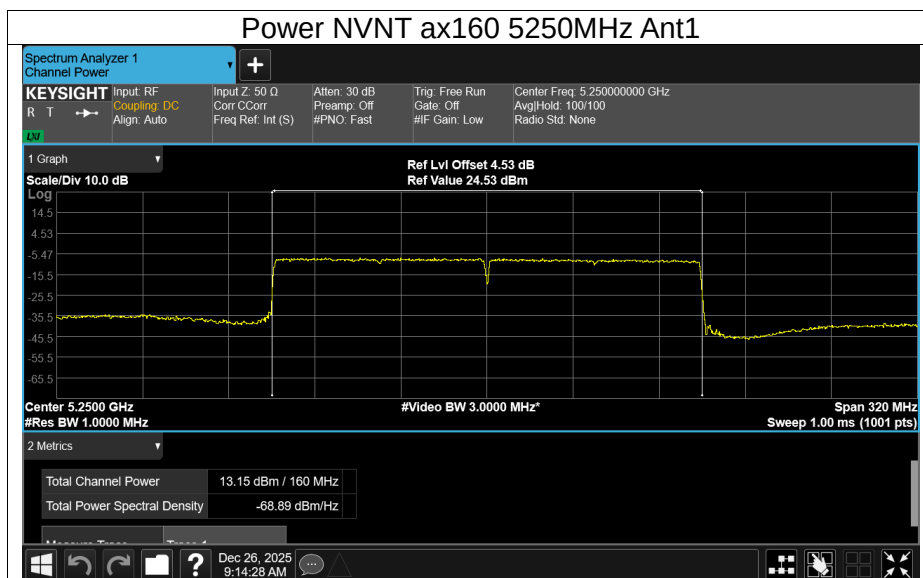

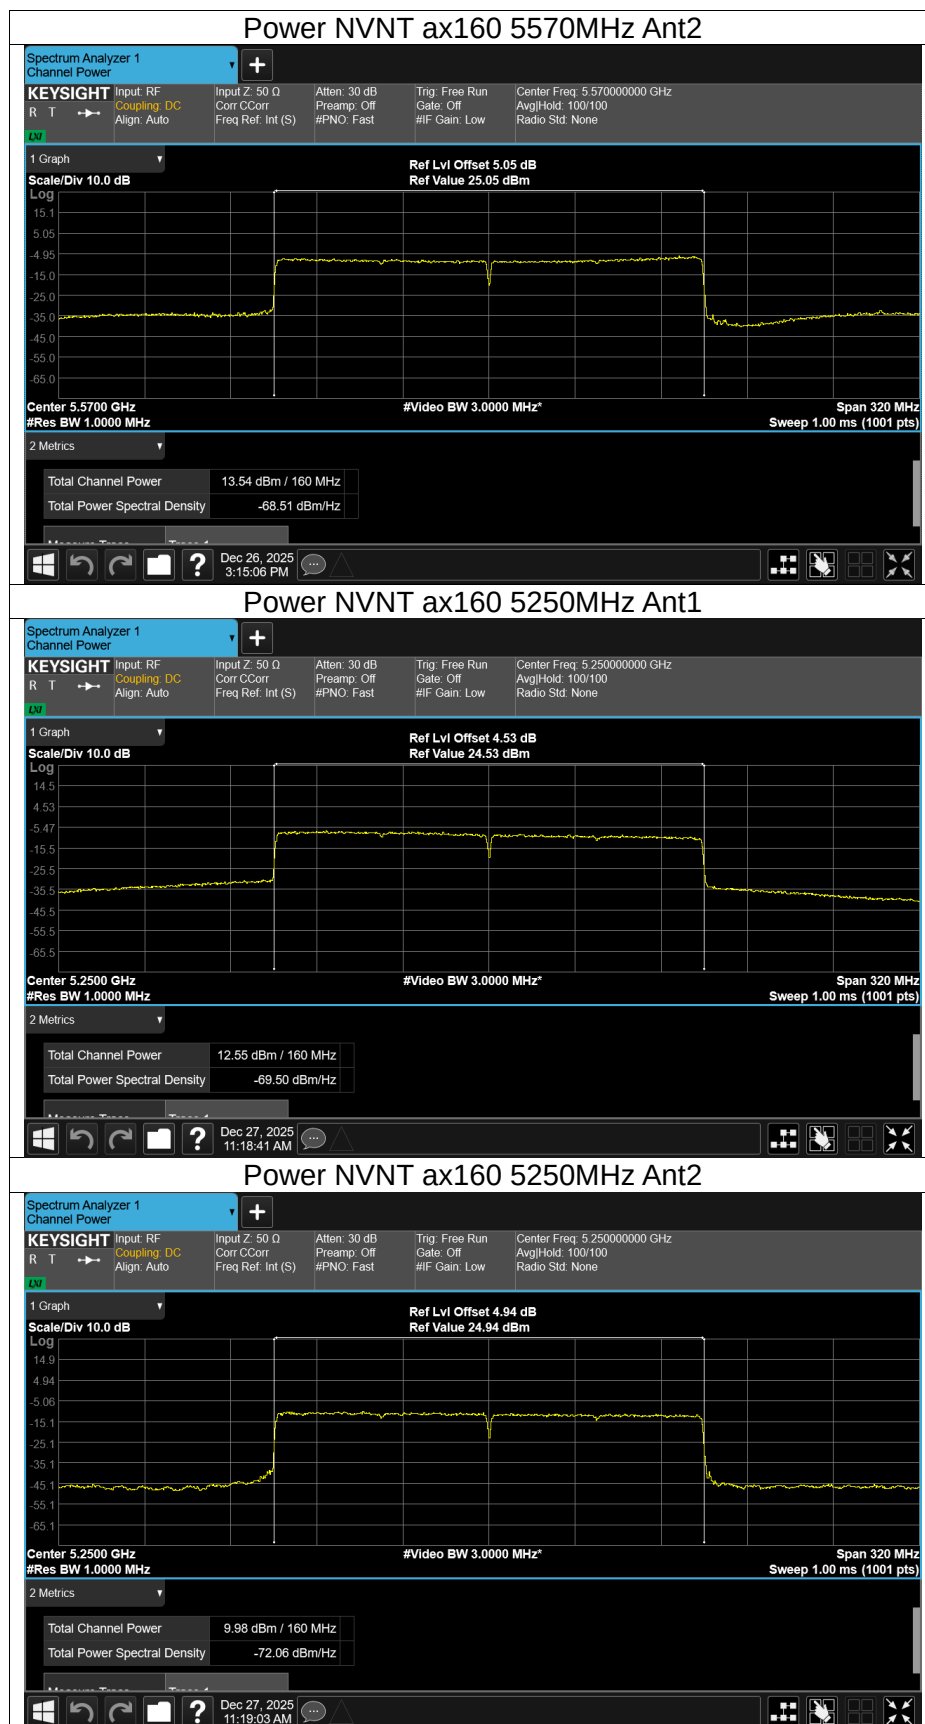

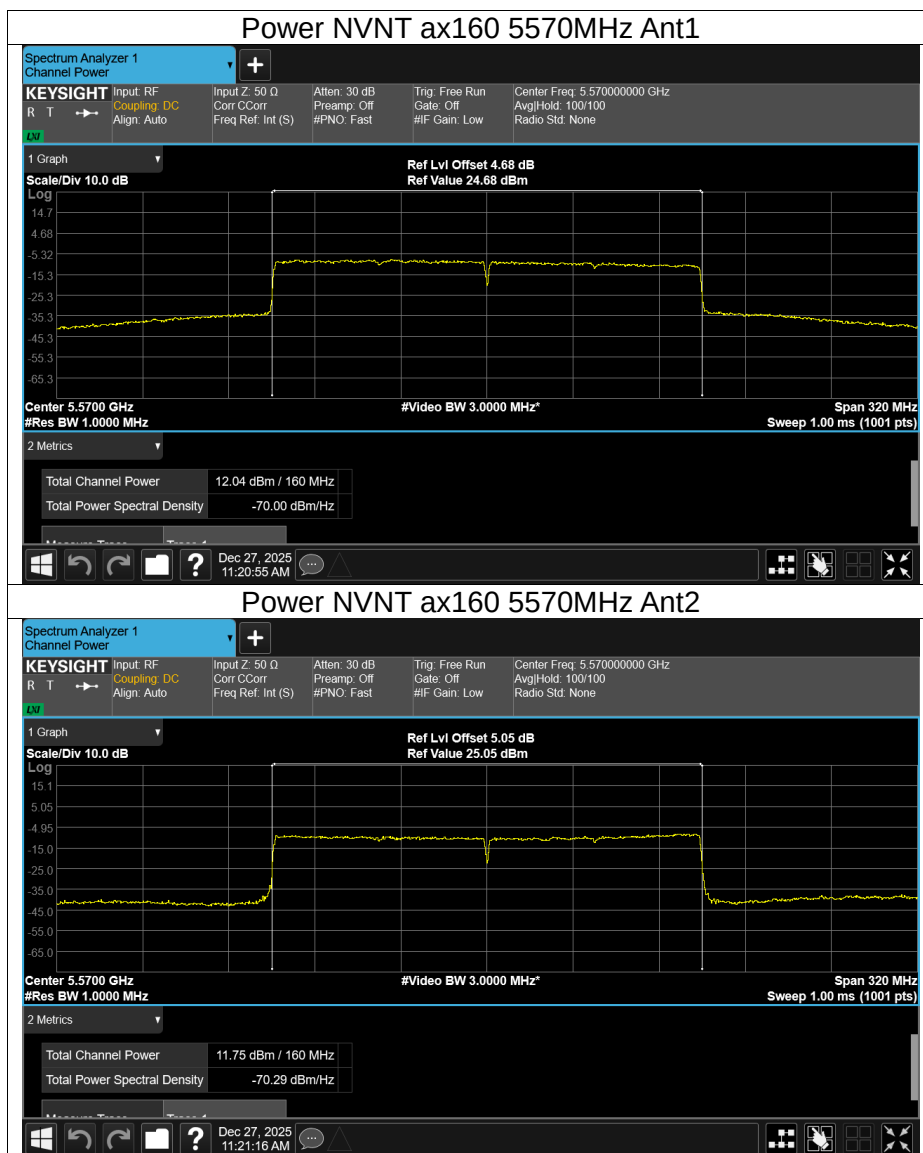



-26dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Verdict
NVNT	a	5180	Ant1	18.753	Pass
NVNT	a	5200	Ant1	18.813	Pass
NVNT	a	5240	Ant1	19.181	Pass
NVNT	a	5260	Ant1	19.137	Pass
NVNT	a	5300	Ant1	19.012	Pass
NVNT	a	5320	Ant1	19.664	Pass
NVNT	a	5500	Ant1	18.804	Pass
NVNT	a	5580	Ant1	19.513	Pass
NVNT	a	5700	Ant1	19.352	Pass
NVNT	a	5180	Ant2	19.44	Pass
NVNT	a	5200	Ant2	19.124	Pass
NVNT	a	5240	Ant2	18.762	Pass
NVNT	a	5260	Ant2	19.109	Pass
NVNT	a	5300	Ant2	19.412	Pass
NVNT	a	5320	Ant2	19.06	Pass
NVNT	a	5500	Ant2	19.29	Pass
NVNT	a	5580	Ant2	19.89	Pass
NVNT	a	5700	Ant2	19.137	Pass
NVNT	n20	5180	Ant1	19.909	Pass
NVNT	n20	5200	Ant1	20.387	Pass
NVNT	n20	5240	Ant1	20.496	Pass
NVNT	n20	5260	Ant1	20.36	Pass
NVNT	n20	5300	Ant1	20.343	Pass
NVNT	n20	5320	Ant1	20.169	Pass
NVNT	n20	5500	Ant1	20.495	Pass
NVNT	n20	5580	Ant1	20.39	Pass
NVNT	n20	5700	Ant1	20.163	Pass
NVNT	n20	5180	Ant2	20.097	Pass
NVNT	n20	5200	Ant2	20.77	Pass
NVNT	n20	5240	Ant2	20.351	Pass
NVNT	n20	5260	Ant2	20.219	Pass
NVNT	n20	5300	Ant2	20.21	Pass
NVNT	n20	5320	Ant2	20.461	Pass
NVNT	n20	5500	Ant2	19.7	Pass
NVNT	n20	5580	Ant2	20.235	Pass
NVNT	n20	5700	Ant2	20.334	Pass
NVNT	n40	5190	Ant1	39.933	Pass
NVNT	n40	5230	Ant1	40.093	Pass
NVNT	n40	5270	Ant1	39.735	Pass
NVNT	n40	5310	Ant1	40.258	Pass
NVNT	n40	5510	Ant1	40.153	Pass
NVNT	n40	5550	Ant1	39.573	Pass
NVNT	n40	5670	Ant1	40.146	Pass
NVNT	n40	5190	Ant2	40.319	Pass
NVNT	n40	5230	Ant2	40.037	Pass
NVNT	n40	5270	Ant2	40.146	Pass
NVNT	n40	5310	Ant2	39.772	Pass
NVNT	n40	5510	Ant2	39.934	Pass
NVNT	n40	5550	Ant2	39.924	Pass
NVNT	n40	5670	Ant2	39.402	Pass
NVNT	ac20	5180	Ant1	20.431	Pass
NVNT	ac20	5200	Ant1	20.09	Pass
NVNT	ac20	5240	Ant1	20.347	Pass
NVNT	ac20	5260	Ant1	20.652	Pass



NVNT	ac20	5300	Ant1	20.079	Pass
NVNT	ac20	5320	Ant1	20.494	Pass
NVNT	ac20	5500	Ant1	20.434	Pass
NVNT	ac20	5580	Ant1	20.502	Pass
NVNT	ac20	5700	Ant1	20.517	Pass
NVNT	ac20	5180	Ant2	20.607	Pass
NVNT	ac20	5200	Ant2	20.632	Pass
NVNT	ac20	5240	Ant2	20.626	Pass
NVNT	ac20	5260	Ant2	20.711	Pass
NVNT	ac20	5300	Ant2	20.491	Pass
NVNT	ac20	5320	Ant2	20.572	Pass
NVNT	ac20	5500	Ant2	20.009	Pass
NVNT	ac20	5580	Ant2	20.564	Pass
NVNT	ac20	5700	Ant2	20.43	Pass
NVNT	ac40	5190	Ant1	39.605	Pass
NVNT	ac40	5230	Ant1	40.141	Pass
NVNT	ac40	5270	Ant1	40.224	Pass
NVNT	ac40	5310	Ant1	39.497	Pass
NVNT	ac40	5510	Ant1	39.896	Pass
NVNT	ac40	5550	Ant1	40.122	Pass
NVNT	ac40	5670	Ant1	39.496	Pass
NVNT	ac40	5190	Ant2	39.999	Pass
NVNT	ac40	5230	Ant2	39.861	Pass
NVNT	ac40	5270	Ant2	40.13	Pass
NVNT	ac40	5310	Ant2	39.716	Pass
NVNT	ac40	5510	Ant2	39.819	Pass
NVNT	ac40	5550	Ant2	39.683	Pass
NVNT	ac40	5670	Ant2	39.822	Pass
NVNT	ac80	5210	Ant1	82.437	Pass
NVNT	ac80	5290	Ant1	81.8	Pass
NVNT	ac80	5530	Ant1	82.636	Pass
NVNT	ac80	5610	Ant1	82.12	Pass
NVNT	ac80	5210	Ant2	82.06	Pass
NVNT	ac80	5290	Ant2	82.093	Pass
NVNT	ac80	5530	Ant2	82.034	Pass
NVNT	ac80	5610	Ant2	82.573	Pass
NVNT	ac160	5250	Ant1	166.29	Pass
NVNT	ac160	5570	Ant1	167.185	Pass
NVNT	ac160	5250	Ant2	165.39	Pass
NVNT	ac160	5570	Ant2	167.765	Pass
NVNT	ax20	5180	Ant1	22.416	Pass
NVNT	ax20	5200	Ant1	22.428	Pass
NVNT	ax20	5240	Ant1	22.396	Pass
NVNT	ax20	5260	Ant1	22.072	Pass
NVNT	ax20	5300	Ant1	22.243	Pass
NVNT	ax20	5320	Ant1	22.498	Pass
NVNT	ax20	5500	Ant1	26.155	Pass
NVNT	ax20	5580	Ant1	27.778	Pass
NVNT	ax20	5700	Ant1	29.853	Pass
NVNT	ax20	5180	Ant2	22.868	Pass
NVNT	ax20	5200	Ant2	22.892	Pass
NVNT	ax20	5240	Ant2	22.317	Pass
NVNT	ax20	5260	Ant2	22.337	Pass
NVNT	ax20	5300	Ant2	23.001	Pass
NVNT	ax20	5320	Ant2	22.49	Pass
NVNT	ax20	5500	Ant2	23.974	Pass



NVNT	ax20	5580	Ant2	29.916	Pass
NVNT	ax20	5700	Ant2	23.015	Pass
NVNT	ax40	5190	Ant1	49.819	Pass
NVNT	ax40	5230	Ant1	52.876	Pass
NVNT	ax40	5270	Ant1	44.296	Pass
NVNT	ax40	5310	Ant1	44.83	Pass
NVNT	ax40	5510	Ant1	59.928	Pass
NVNT	ax40	5550	Ant1	44.988	Pass
NVNT	ax40	5670	Ant1	44.447	Pass
NVNT	ax40	5190	Ant2	43.976	Pass
NVNT	ax40	5230	Ant2	44.199	Pass
NVNT	ax40	5270	Ant2	44.905	Pass
NVNT	ax40	5310	Ant2	44.92	Pass
NVNT	ax40	5510	Ant2	45.271	Pass
NVNT	ax40	5550	Ant2	52.535	Pass
NVNT	ax40	5670	Ant2	44.04	Pass
NVNT	ax80	5210	Ant1	119.721	Pass
NVNT	ax80	5290	Ant1	117.808	Pass
NVNT	ax80	5530	Ant1	92.319	Pass
NVNT	ax80	5610	Ant1	102.343	Pass
NVNT	ax80	5210	Ant2	97.1	Pass
NVNT	ax80	5290	Ant2	109.054	Pass
NVNT	ax80	5530	Ant2	108.109	Pass
NVNT	ax80	5610	Ant2	111.753	Pass
NVNT	ax160	5250	Ant1	239.775	Pass
NVNT	ax160	5570	Ant1	238.004	Pass
NVNT	ax160	5250	Ant2	231.657	Pass
NVNT	ax160	5570	Ant2	239.569	Pass

