






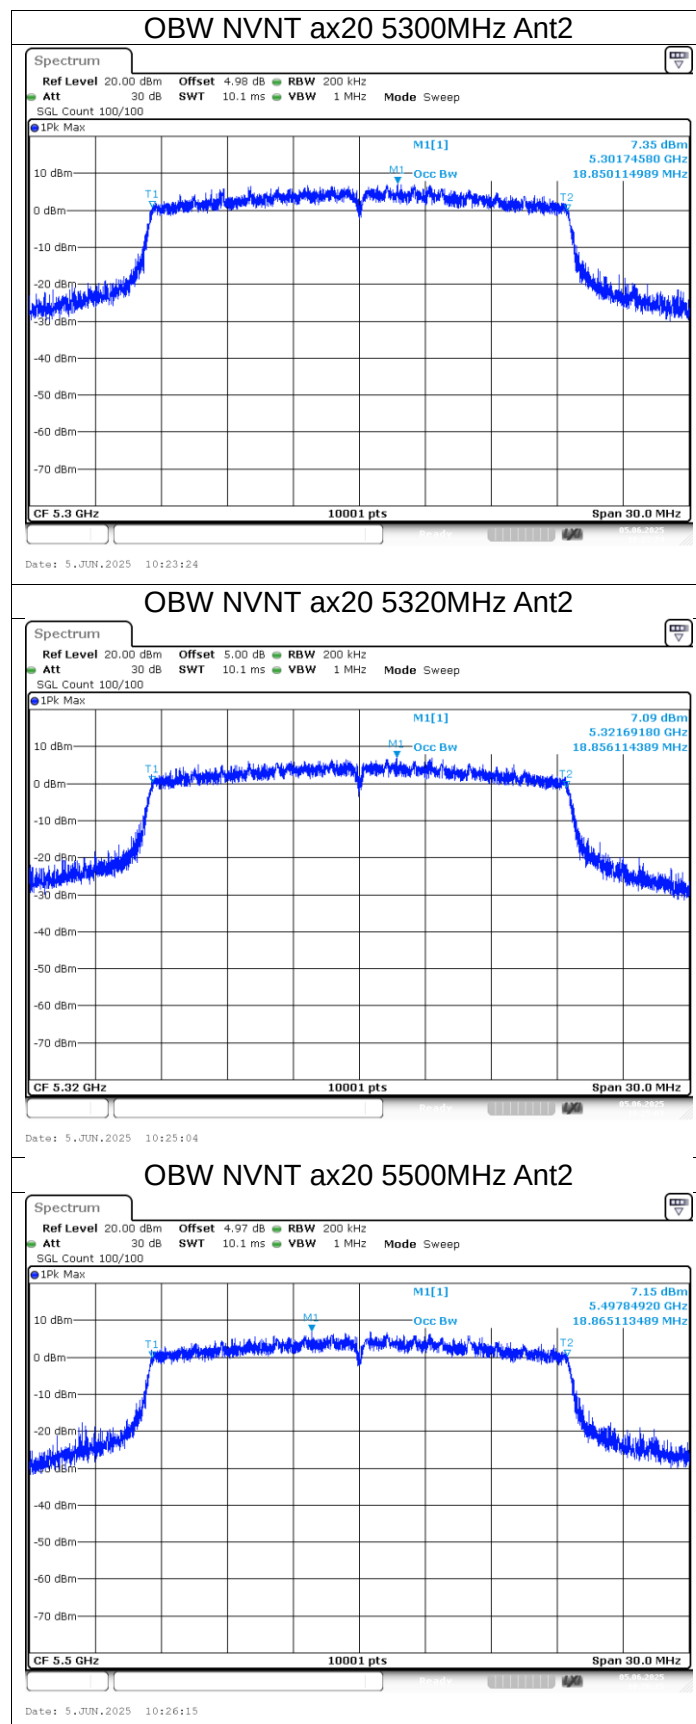


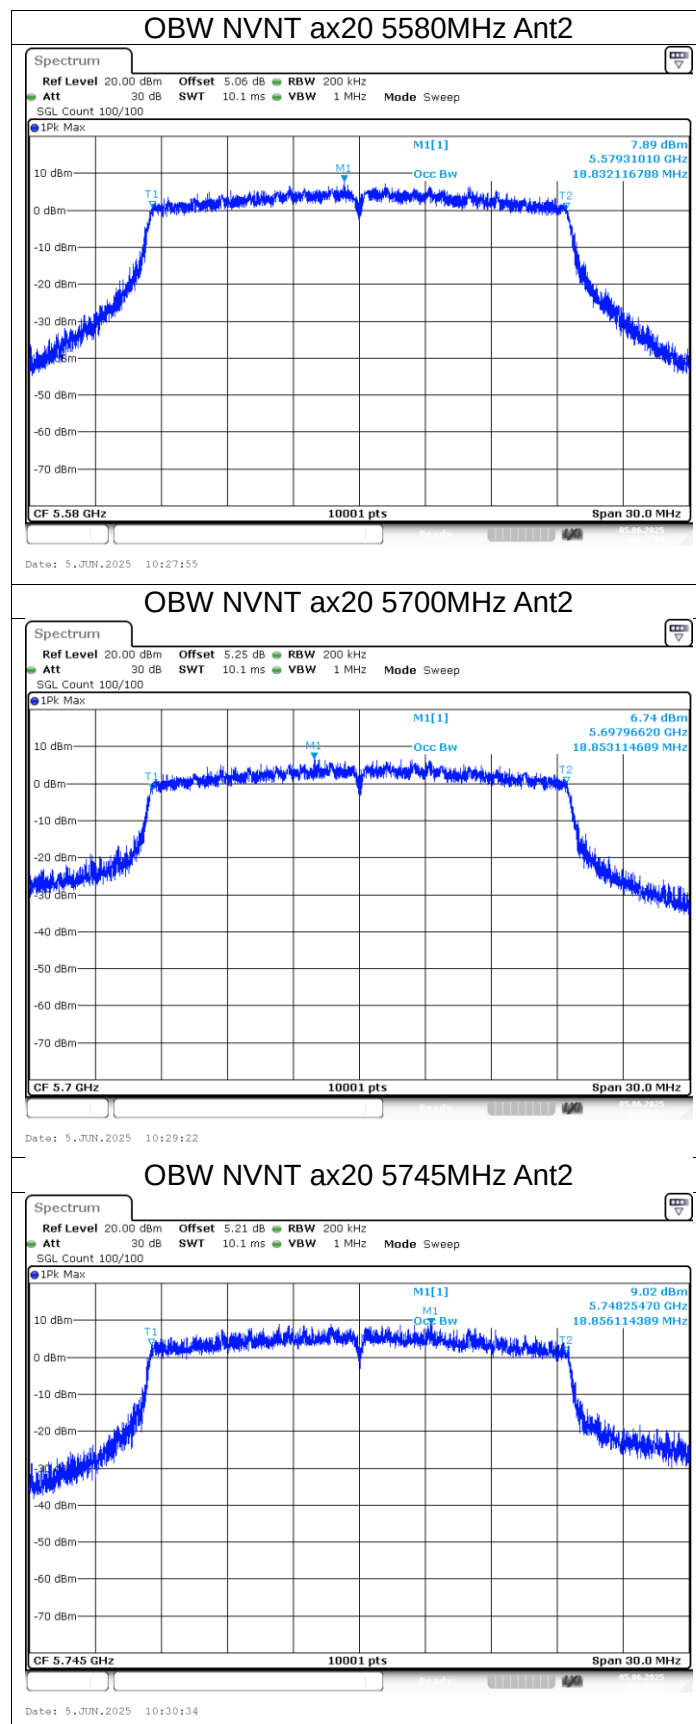


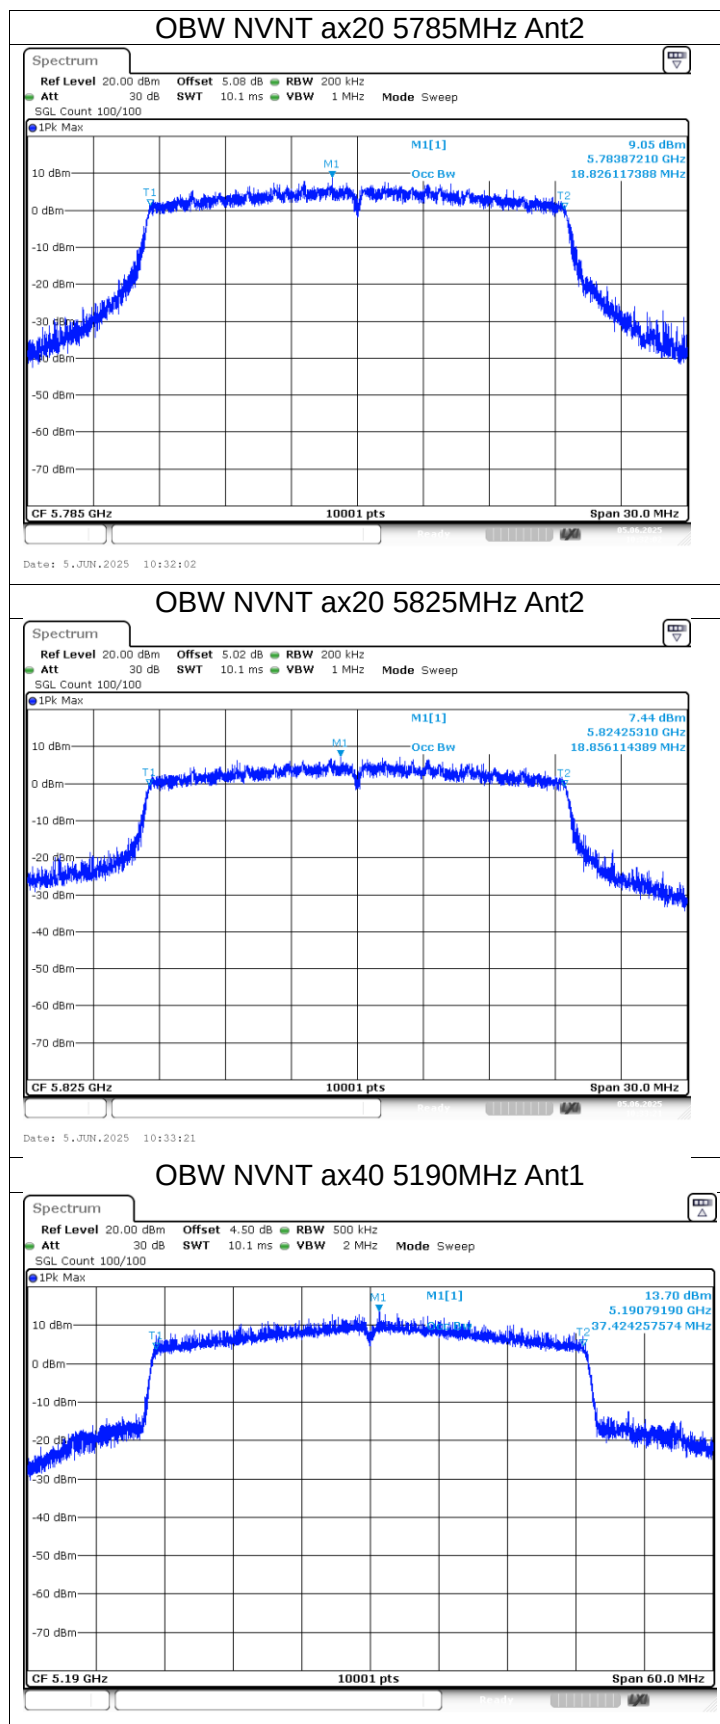


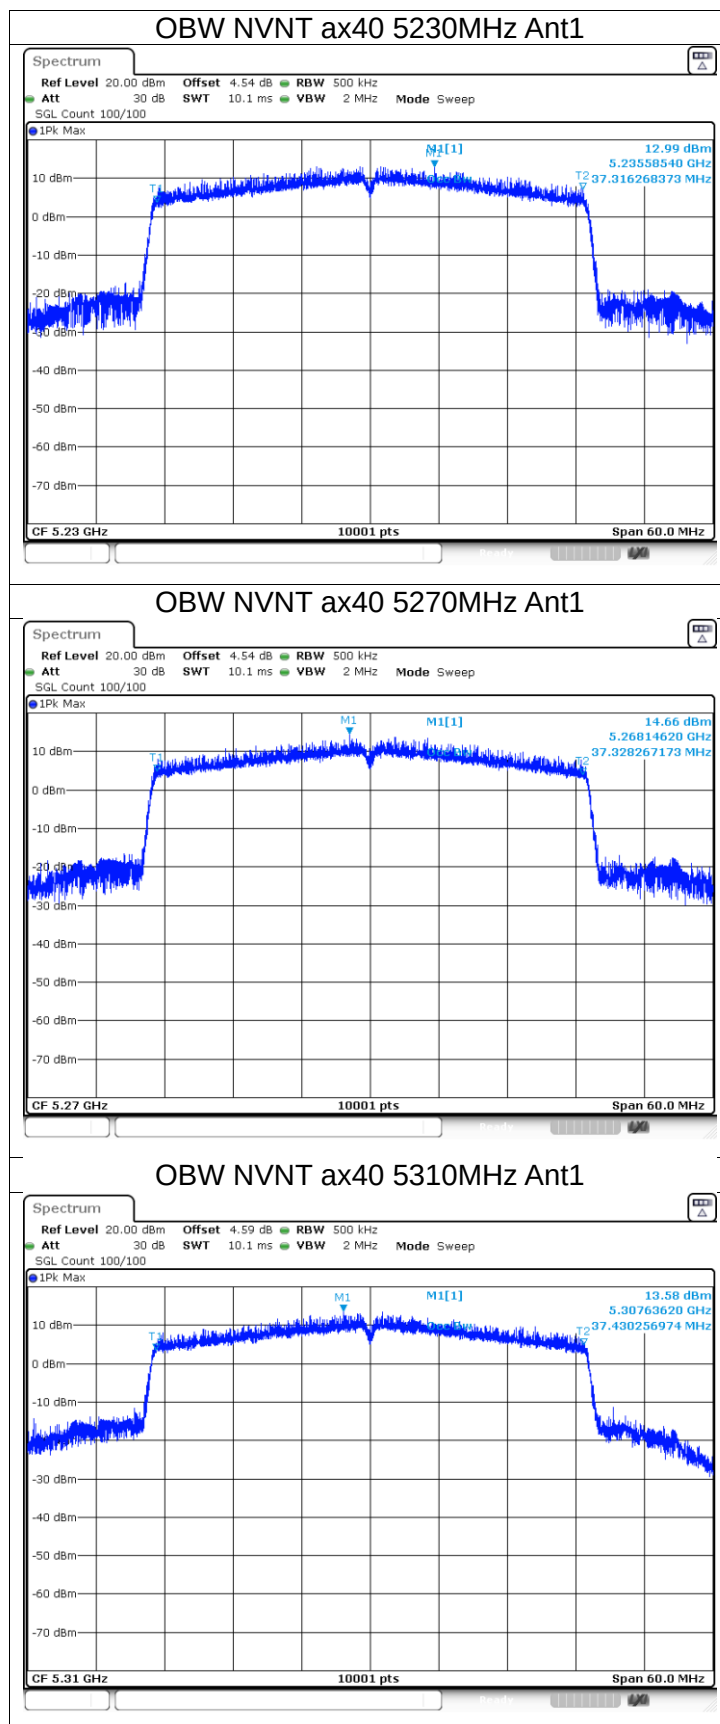


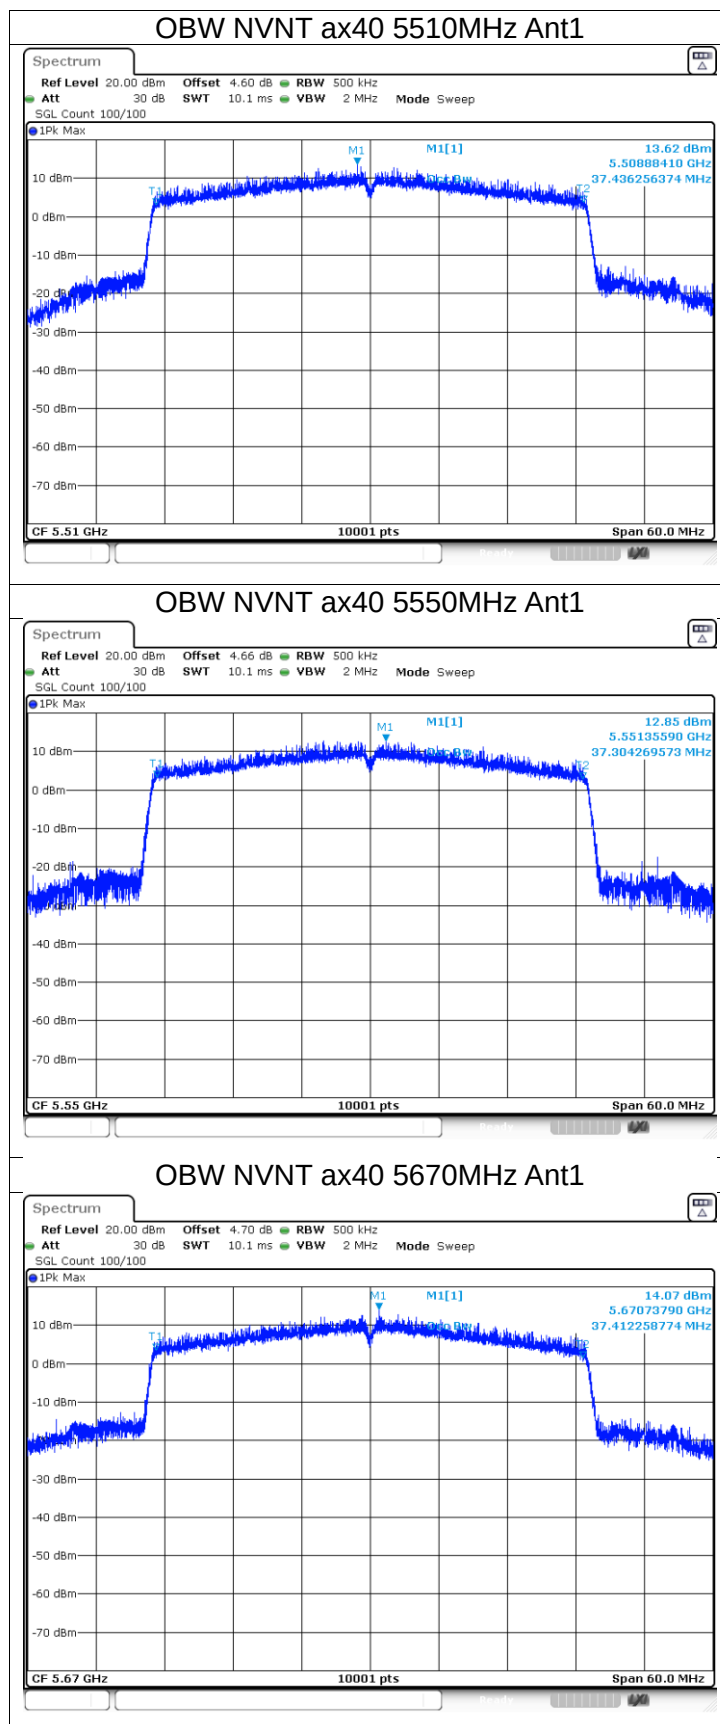


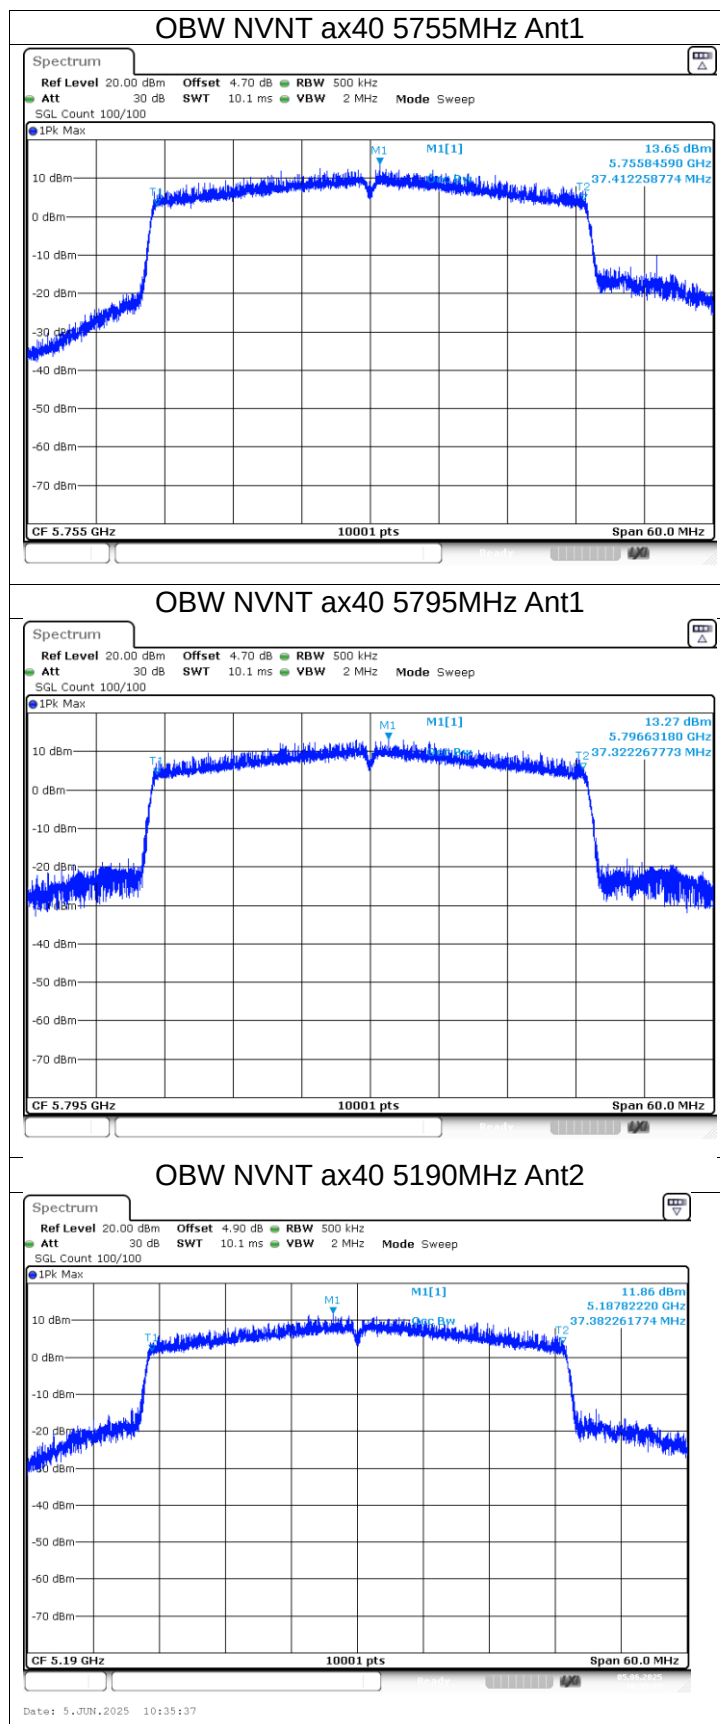


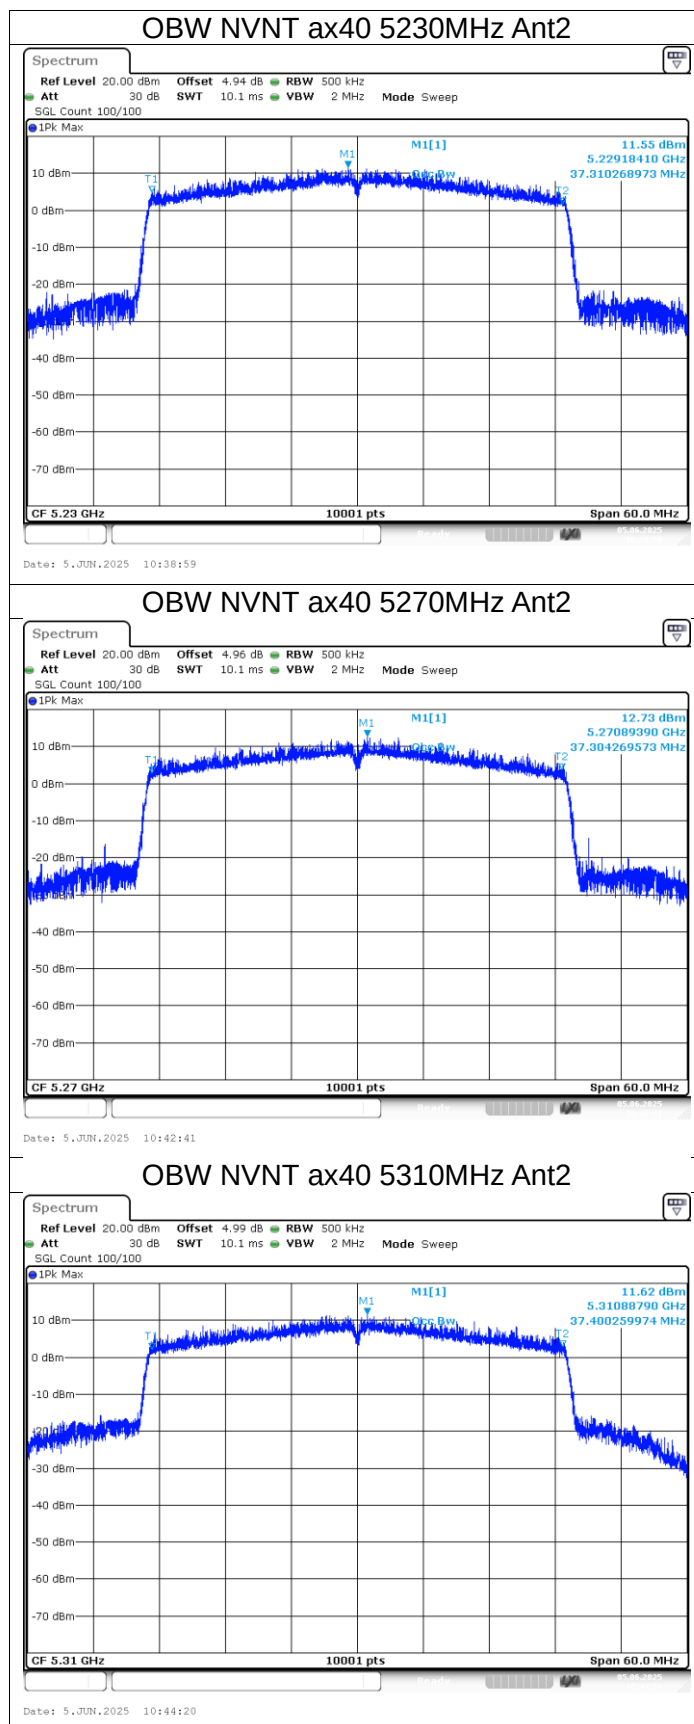


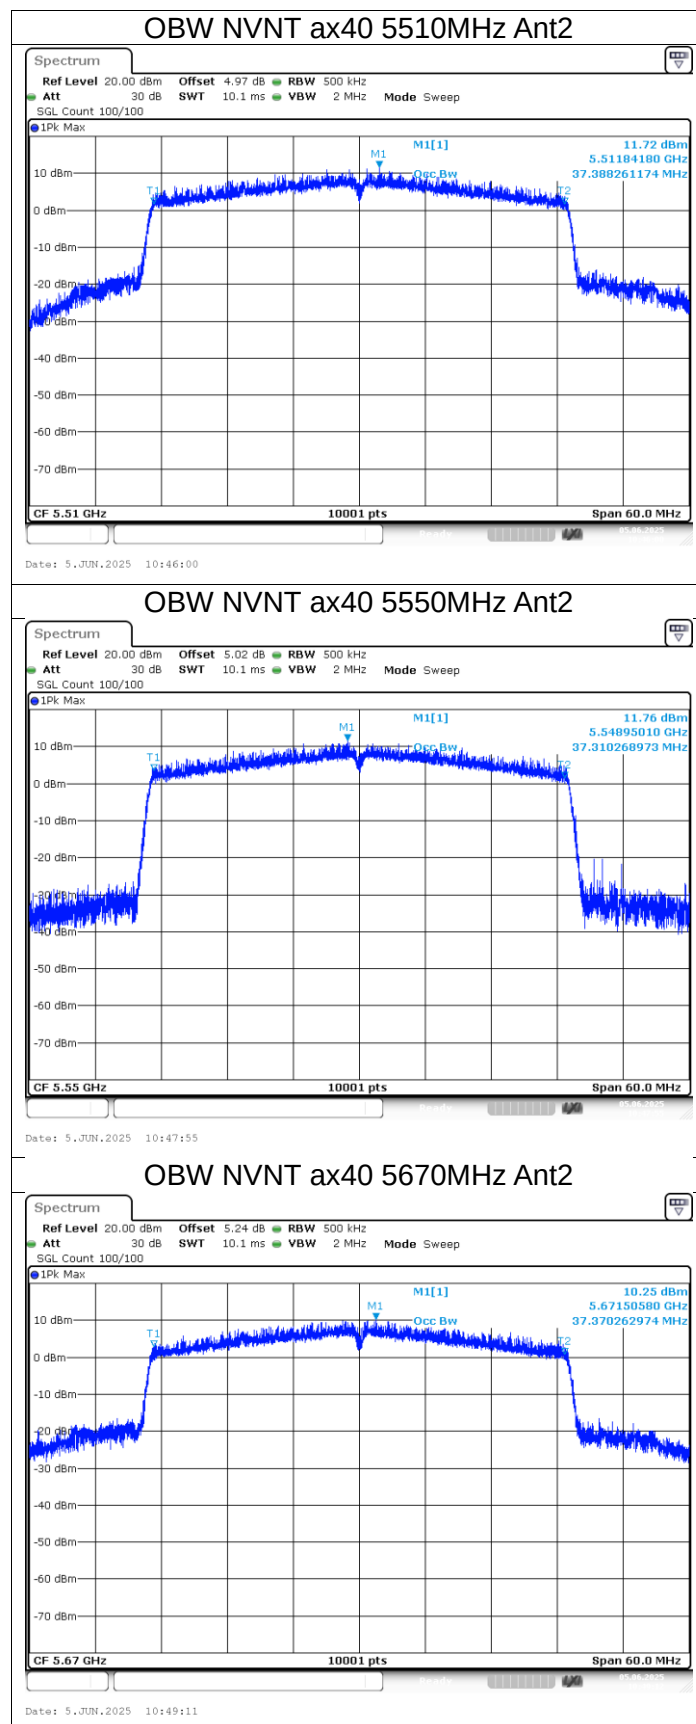


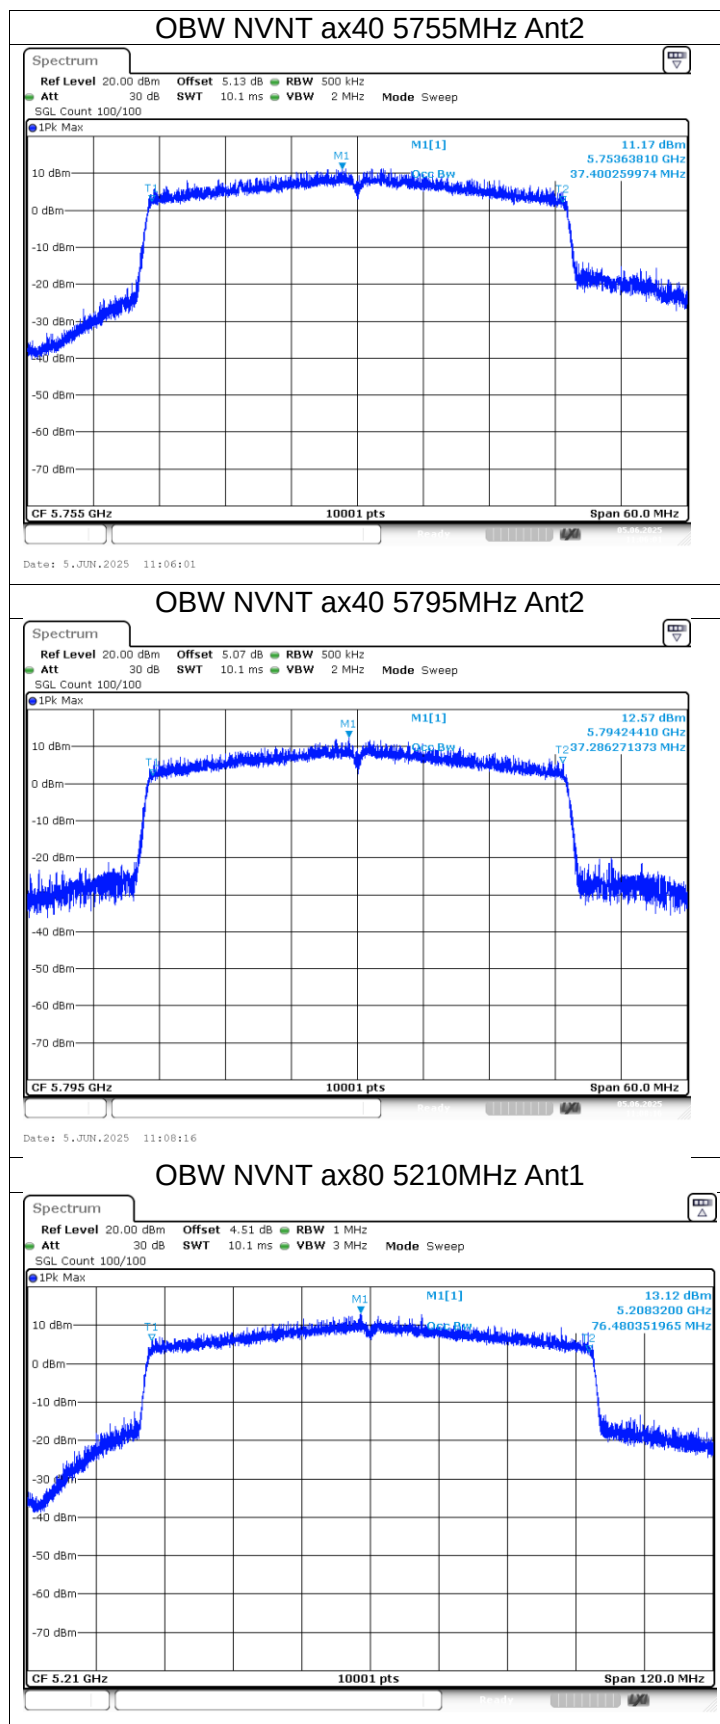


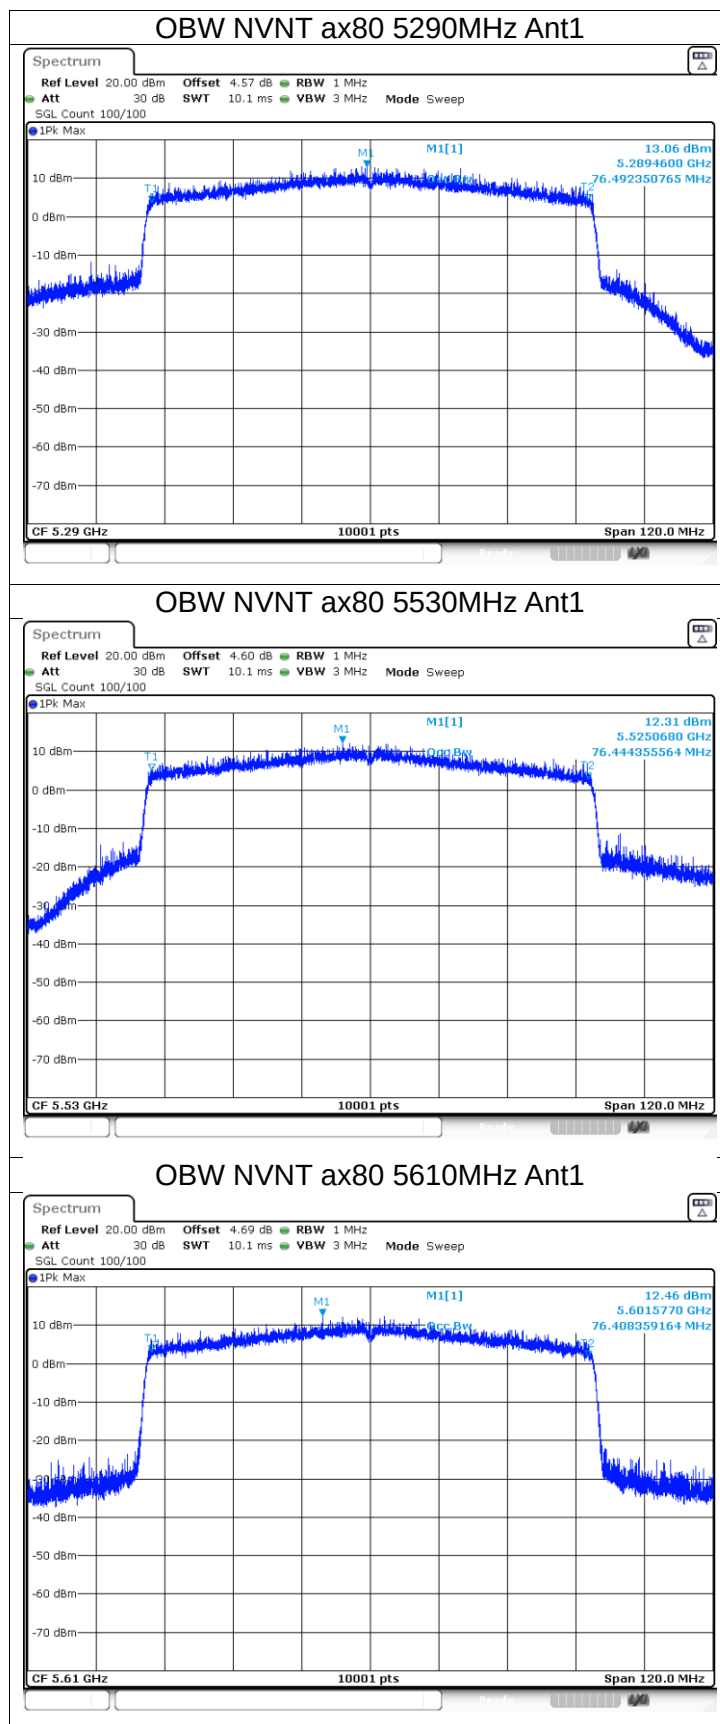

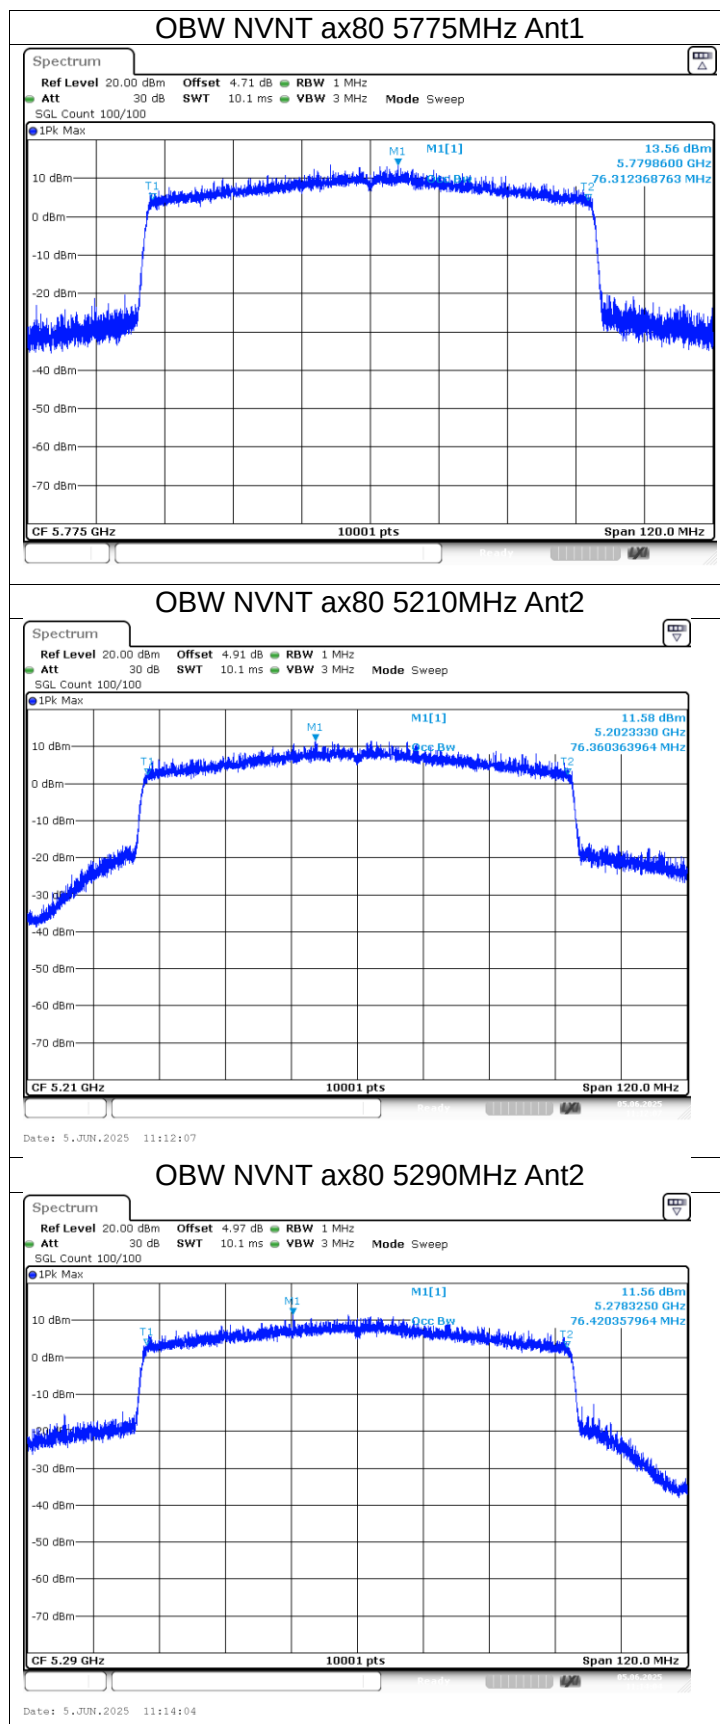

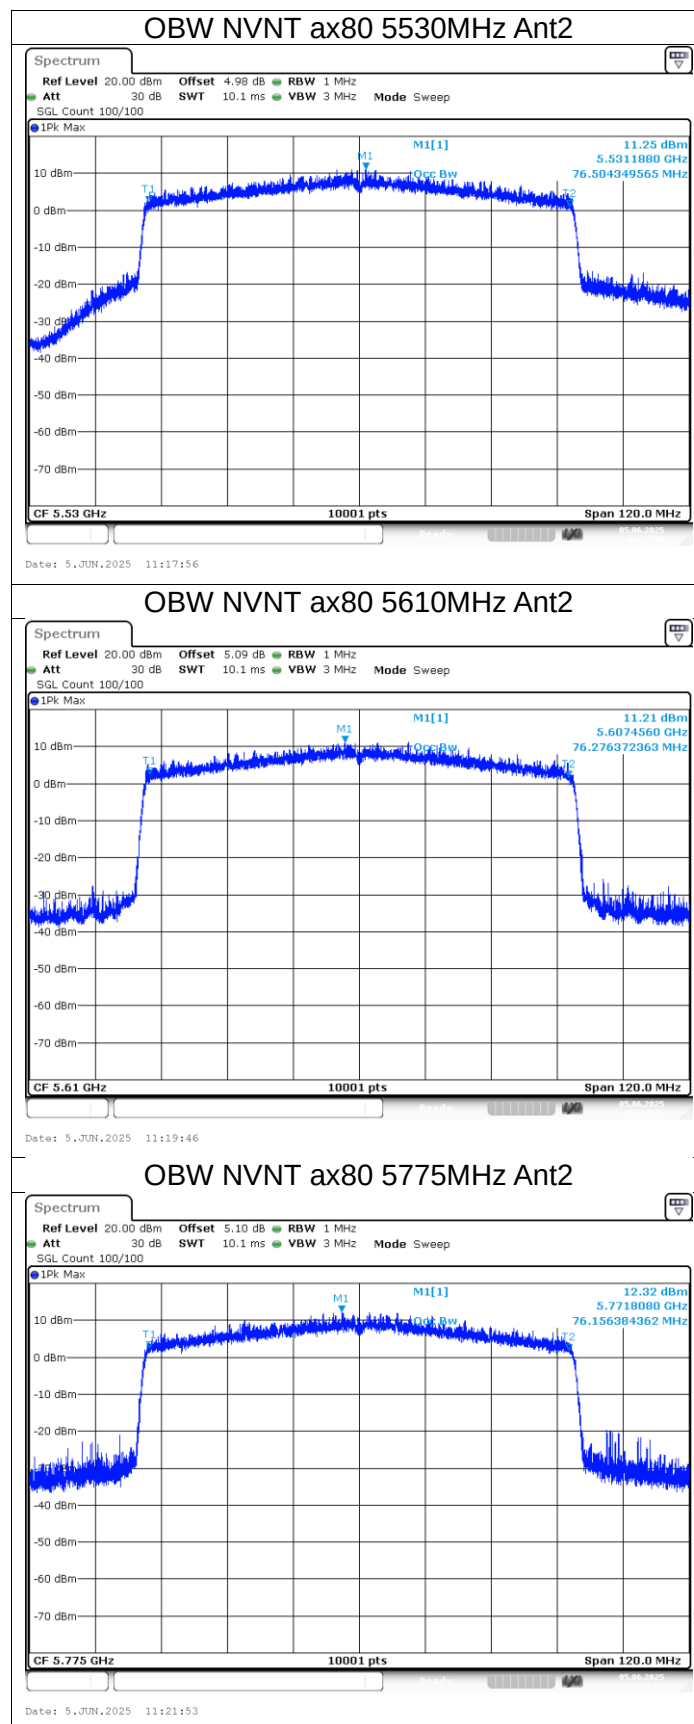

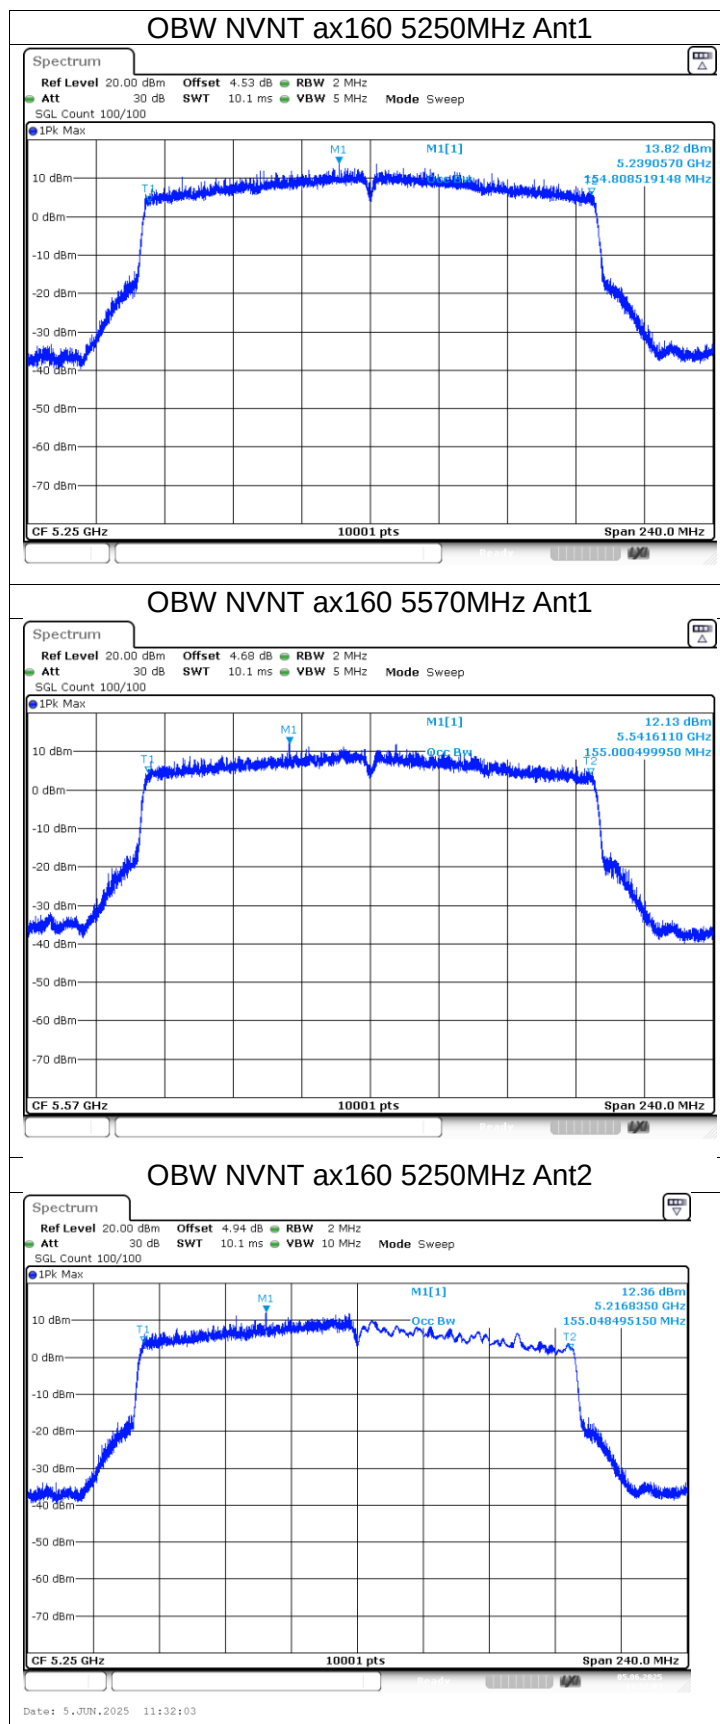

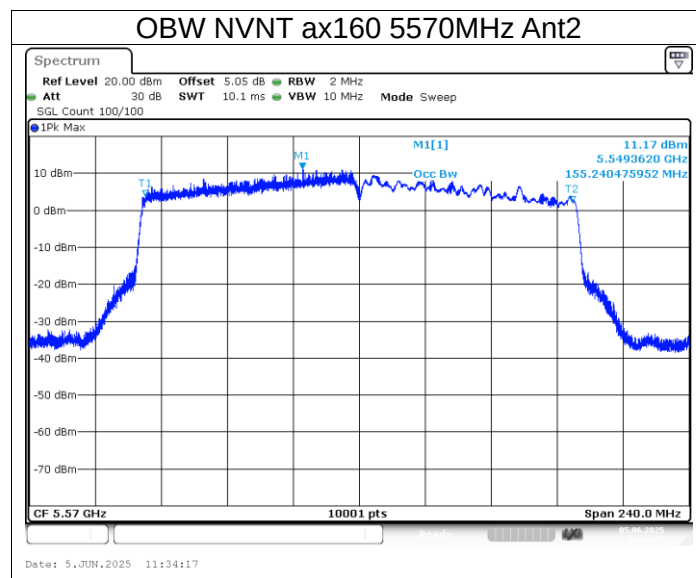



## Maximum Power Spectral Density Level

| Condition | Mode | Frequency (MHz) | Antenna | Conducted PSD (dBm /MHz) | Duty Factor (dB) | Total PSD (dBm/ MHz) | Limit (dBm/ MHz) | Verdict |
|-----------|------|-----------------|---------|--------------------------|------------------|----------------------|------------------|---------|
| NVNT      | a    | 5180            | Ant1    | 4.52                     | 0.17             | 4.69                 | 11               | Pass    |
| NVNT      | a    | 5200            | Ant1    | 4.76                     | 0.17             | 4.93                 | 11               | Pass    |
| NVNT      | a    | 5240            | Ant1    | 5                        | 0.17             | 5.17                 | 11               | Pass    |
| NVNT      | a    | 5260            | Ant1    | 5.37                     | 0.17             | 5.54                 | 11               | Pass    |
| NVNT      | a    | 5300            | Ant1    | 4.9                      | 0.17             | 5.07                 | 11               | Pass    |
| NVNT      | a    | 5320            | Ant1    | 4.76                     | 0.17             | 4.93                 | 11               | Pass    |
| NVNT      | a    | 5500            | Ant1    | 4.05                     | 0.17             | 4.22                 | 11               | Pass    |
| NVNT      | a    | 5580            | Ant1    | 3.96                     | 0.17             | 4.13                 | 11               | Pass    |
| NVNT      | a    | 5700            | Ant1    | 3.42                     | 0.17             | 3.59                 | 11               | Pass    |
| NVNT      | a    | 5180            | Ant2    | 4.32                     | 0.17             | 4.49                 | 11               | Pass    |
| NVNT      | a    | 5200            | Ant2    | 4.66                     | 0.17             | 4.83                 | 11               | Pass    |
| NVNT      | a    | 5240            | Ant2    | 4.78                     | 0.17             | 4.95                 | 11               | Pass    |
| NVNT      | a    | 5260            | Ant2    | 5.17                     | 0.17             | 5.34                 | 11               | Pass    |
| NVNT      | a    | 5300            | Ant2    | 4.79                     | 0.17             | 4.96                 | 11               | Pass    |
| NVNT      | a    | 5320            | Ant2    | 4.91                     | 0                | 4.91                 | 11               | Pass    |
| NVNT      | a    | 5500            | Ant2    | 4.61                     | 0.17             | 4.78                 | 11               | Pass    |
| NVNT      | a    | 5580            | Ant2    | 4.71                     | 0.17             | 4.88                 | 11               | Pass    |
| NVNT      | a    | 5700            | Ant2    | 4.14                     | 0.17             | 4.31                 | 11               | Pass    |
| NVNT      | n20  | 5180            | Ant1    | 4.28                     | 0.19             | 4.47                 | 11               | Pass    |
| NVNT      | n20  | 5200            | Ant1    | 4.67                     | 0.18             | 4.85                 | 11               | Pass    |
| NVNT      | n20  | 5240            | Ant1    | 4.94                     | 0.19             | 5.13                 | 11               | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 6.8                      | 0.19             | 6.99                 | 11               | Pass    |
| NVNT      | n20  | 5300            | Ant1    | 4.57                     | 0.18             | 4.75                 | 11               | Pass    |
| NVNT      | n20  | 5320            | Ant1    | 4.51                     | 0.19             | 4.7                  | 11               | Pass    |
| NVNT      | n20  | 5500            | Ant1    | 3.75                     | 0.18             | 3.93                 | 11               | Pass    |
| NVNT      | n20  | 5580            | Ant1    | 3.69                     | 0.18             | 3.87                 | 11               | Pass    |
| NVNT      | n20  | 5700            | Ant1    | 3.05                     | 0.19             | 3.24                 | 11               | Pass    |
| NVNT      | n20  | 5180            | Ant2    | 3.98                     | 0.18             | 4.16                 | 11               | Pass    |
| NVNT      | n20  | 5200            | Ant2    | 4.2                      | 0.19             | 4.39                 | 11               | Pass    |
| NVNT      | n20  | 5240            | Ant2    | 4.53                     | 0.19             | 4.72                 | 11               | Pass    |
| NVNT      | n20  | 5260            | Ant2    | 4.93                     | 0.19             | 5.12                 | 11               | Pass    |
| NVNT      | n20  | 5300            | Ant2    | 4.36                     | 0.19             | 4.55                 | 11               | Pass    |
| NVNT      | n20  | 5320            | Ant2    | 4.46                     | 0                | 4.46                 | 11               | Pass    |
| NVNT      | n20  | 5500            | Ant2    | 4.32                     | 0.19             | 4.51                 | 11               | Pass    |
| NVNT      | n20  | 5580            | Ant2    | 4.49                     | 0.19             | 4.68                 | 11               | Pass    |
| NVNT      | n20  | 5700            | Ant2    | 3.86                     | 0.19             | 4.05                 | 11               | Pass    |
| NVNT      | n20  | 5180            | Ant1    | 4.1                      | 0.19             | 4.29                 | 11               | Pass    |
| NVNT      | n20  | 5180            | Ant2    | 1.49                     | 0.19             | 1.68                 | 11               | Pass    |
| NVNT      | n20  | 5180            | MIMO    | 6                        | 0.19             | 6.19                 | 11               | Pass    |
| NVNT      | n20  | 5200            | Ant1    | 4.67                     | 0.19             | 4.86                 | 11               | Pass    |
| NVNT      | n20  | 5200            | Ant2    | 1.89                     | 0.19             | 2.08                 | 11               | Pass    |
| NVNT      | n20  | 5200            | MIMO    | 6.51                     | 0.19             | 6.7                  | 11               | Pass    |
| NVNT      | n20  | 5240            | Ant1    | 4.97                     | 0.18             | 5.15                 | 11               | Pass    |
| NVNT      | n20  | 5240            | Ant2    | 2.55                     | 0.18             | 2.73                 | 11               | Pass    |
| NVNT      | n20  | 5240            | MIMO    | 6.94                     | 0.18             | 7.12                 | 11               | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 5.17                     | 0.19             | 5.36                 | 11               | Pass    |
| NVNT      | n20  | 5260            | Ant2    | 2.9                      | 0.19             | 3.09                 | 11               | Pass    |
| NVNT      | n20  | 5260            | MIMO    | 7.19                     | 0.19             | 7.38                 | 11               | Pass    |
| NVNT      | n20  | 5300            | Ant1    | 4.62                     | 0.19             | 4.81                 | 11               | Pass    |
| NVNT      | n20  | 5300            | Ant2    | 2.5                      | 0.19             | 2.69                 | 11               | Pass    |
| NVNT      | n20  | 5300            | MIMO    | 6.7                      | 0.19             | 6.89                 | 11               | Pass    |



|      |      |      |      |       |      |      |    |      |
|------|------|------|------|-------|------|------|----|------|
| NVNT | n20  | 5320 | Ant1 | 4.64  | 0.19 | 4.83 | 11 | Pass |
| NVNT | n20  | 5320 | Ant2 | 2.81  | 0.19 | 3    | 11 | Pass |
| NVNT | n20  | 5320 | MIMO | 6.83  | 0.19 | 7.02 | 11 | Pass |
| NVNT | n20  | 5500 | Ant1 | 4.06  | 0.19 | 4.25 | 11 | Pass |
| NVNT | n20  | 5500 | Ant2 | 2.93  | 0.19 | 3.12 | 11 | Pass |
| NVNT | n20  | 5500 | MIMO | 6.54  | 0.19 | 6.73 | 11 | Pass |
| NVNT | n20  | 5580 | Ant1 | 3.27  | 0.18 | 3.45 | 11 | Pass |
| NVNT | n20  | 5580 | Ant2 | 3.22  | 0.18 | 3.4  | 11 | Pass |
| NVNT | n20  | 5580 | MIMO | 6.26  | 0.18 | 6.44 | 11 | Pass |
| NVNT | n20  | 5700 | Ant1 | 3.1   | 0.18 | 3.28 | 11 | Pass |
| NVNT | n20  | 5700 | Ant2 | 3.01  | 0.18 | 3.19 | 11 | Pass |
| NVNT | n20  | 5700 | MIMO | 6.07  | 0.18 | 6.25 | 11 | Pass |
| NVNT | n40  | 5190 | Ant1 | 2.52  | 0.37 | 2.89 | 11 | Pass |
| NVNT | n40  | 5230 | Ant1 | 2.96  | 0.37 | 3.33 | 11 | Pass |
| NVNT | n40  | 5270 | Ant1 | 3.91  | 0.37 | 4.28 | 11 | Pass |
| NVNT | n40  | 5310 | Ant1 | 3.04  | 0.37 | 3.41 | 11 | Pass |
| NVNT | n40  | 5510 | Ant1 | 2.34  | 0.37 | 2.71 | 11 | Pass |
| NVNT | n40  | 5550 | Ant1 | 2.27  | 0.37 | 2.64 | 11 | Pass |
| NVNT | n40  | 5670 | Ant1 | 2.45  | 0.37 | 2.82 | 11 | Pass |
| NVNT | n40  | 5190 | Ant2 | 2.34  | 0.37 | 2.71 | 11 | Pass |
| NVNT | n40  | 5230 | Ant2 | 5.84  | 0.37 | 6.21 | 11 | Pass |
| NVNT | n40  | 5270 | Ant2 | 3.46  | 0.37 | 3.83 | 11 | Pass |
| NVNT | n40  | 5310 | Ant2 | 2.84  | 0.37 | 3.21 | 11 | Pass |
| NVNT | n40  | 5510 | Ant2 | 2.6   | 0.37 | 2.97 | 11 | Pass |
| NVNT | n40  | 5550 | Ant2 | 2.83  | 0.37 | 3.2  | 11 | Pass |
| NVNT | n40  | 5670 | Ant2 | 2.28  | 0.36 | 2.64 | 11 | Pass |
| NVNT | n40  | 5190 | Ant1 | 2.49  | 0.36 | 2.85 | 11 | Pass |
| NVNT | n40  | 5190 | Ant2 | -0.26 | 0.36 | 0.1  | 11 | Pass |
| NVNT | n40  | 5190 | MIMO | 4.34  | 0.36 | 4.7  | 11 | Pass |
| NVNT | n40  | 5230 | Ant1 | 2.95  | 0.36 | 3.31 | 11 | Pass |
| NVNT | n40  | 5230 | Ant2 | 0.51  | 0.36 | 0.87 | 11 | Pass |
| NVNT | n40  | 5230 | MIMO | 4.91  | 0.36 | 5.27 | 11 | Pass |
| NVNT | n40  | 5270 | Ant1 | 3.45  | 0.37 | 3.82 | 11 | Pass |
| NVNT | n40  | 5270 | Ant2 | 1.22  | 0.37 | 1.59 | 11 | Pass |
| NVNT | n40  | 5270 | MIMO | 5.49  | 0.37 | 5.86 | 11 | Pass |
| NVNT | n40  | 5310 | Ant1 | 2.59  | 0.37 | 2.96 | 11 | Pass |
| NVNT | n40  | 5310 | Ant2 | 0.87  | 0.37 | 1.24 | 11 | Pass |
| NVNT | n40  | 5310 | MIMO | 4.82  | 0.37 | 5.19 | 11 | Pass |
| NVNT | n40  | 5510 | Ant1 | 2.17  | 0.37 | 2.54 | 11 | Pass |
| NVNT | n40  | 5510 | Ant2 | 1.24  | 0.37 | 1.61 | 11 | Pass |
| NVNT | n40  | 5510 | MIMO | 4.74  | 0.37 | 5.11 | 11 | Pass |
| NVNT | n40  | 5550 | Ant1 | 1.75  | 0.37 | 2.12 | 11 | Pass |
| NVNT | n40  | 5550 | Ant2 | 1.1   | 0.37 | 1.47 | 11 | Pass |
| NVNT | n40  | 5550 | MIMO | 4.45  | 0.37 | 4.82 | 11 | Pass |
| NVNT | n40  | 5670 | Ant1 | 1.88  | 0.37 | 2.25 | 11 | Pass |
| NVNT | n40  | 5670 | Ant2 | 0.85  | 0.37 | 1.22 | 11 | Pass |
| NVNT | n40  | 5670 | MIMO | 4.41  | 0.37 | 4.78 | 11 | Pass |
| NVNT | ac20 | 5180 | Ant1 | 4.05  | 0.49 | 4.54 | 11 | Pass |
| NVNT | ac20 | 5200 | Ant1 | 4.18  | 0.48 | 4.66 | 11 | Pass |
| NVNT | ac20 | 5240 | Ant1 | 4.48  | 0.49 | 4.97 | 11 | Pass |
| NVNT | ac20 | 5260 | Ant1 | 4.92  | 0.49 | 5.41 | 11 | Pass |
| NVNT | ac20 | 5300 | Ant1 | 4.47  | 0.49 | 4.96 | 11 | Pass |
| NVNT | ac20 | 5320 | Ant1 | 4.41  | 0.48 | 4.89 | 11 | Pass |
| NVNT | ac20 | 5500 | Ant1 | 3.66  | 0.49 | 4.15 | 11 | Pass |
| NVNT | ac20 | 5580 | Ant1 | 3.44  | 0.49 | 3.93 | 11 | Pass |
| NVNT | ac20 | 5700 | Ant1 | 2.83  | 0.49 | 3.32 | 11 | Pass |



|      |      |      |      |       |      |      |    |      |
|------|------|------|------|-------|------|------|----|------|
| NVNT | ac20 | 5180 | Ant2 | 3.8   | 0.48 | 4.28 | 11 | Pass |
| NVNT | ac20 | 5200 | Ant2 | 4.19  | 0.48 | 4.67 | 11 | Pass |
| NVNT | ac20 | 5240 | Ant2 | 4.43  | 0.49 | 4.92 | 11 | Pass |
| NVNT | ac20 | 5260 | Ant2 | 5.01  | 0.49 | 5.5  | 11 | Pass |
| NVNT | ac20 | 5300 | Ant2 | 4.18  | 0.48 | 4.66 | 11 | Pass |
| NVNT | ac20 | 5320 | Ant2 | 4.37  | 0.49 | 4.86 | 11 | Pass |
| NVNT | ac20 | 5500 | Ant2 | 4.27  | 0.48 | 4.75 | 11 | Pass |
| NVNT | ac20 | 5580 | Ant2 | 4.23  | 0.49 | 4.72 | 11 | Pass |
| NVNT | ac20 | 5700 | Ant2 | 4.09  | 0.48 | 4.57 | 11 | Pass |
| NVNT | ac20 | 5180 | Ant1 | 4.24  | 0.49 | 4.73 | 11 | Pass |
| NVNT | ac20 | 5180 | Ant2 | 1.59  | 0.49 | 2.08 | 11 | Pass |
| NVNT | ac20 | 5180 | MIMO | 6.12  | 0.49 | 6.61 | 11 | Pass |
| NVNT | ac20 | 5200 | Ant1 | 4.67  | 0.49 | 5.16 | 11 | Pass |
| NVNT | ac20 | 5200 | Ant2 | 1.91  | 0.49 | 2.4  | 11 | Pass |
| NVNT | ac20 | 5200 | MIMO | 6.52  | 0.49 | 7.01 | 11 | Pass |
| NVNT | ac20 | 5240 | Ant1 | 4.85  | 0.49 | 5.34 | 11 | Pass |
| NVNT | ac20 | 5240 | Ant2 | 2.18  | 0.49 | 2.67 | 11 | Pass |
| NVNT | ac20 | 5240 | MIMO | 6.73  | 0.49 | 7.22 | 11 | Pass |
| NVNT | ac20 | 5260 | Ant1 | 4.88  | 0.49 | 5.37 | 11 | Pass |
| NVNT | ac20 | 5260 | Ant2 | 2.62  | 0.49 | 3.11 | 11 | Pass |
| NVNT | ac20 | 5260 | MIMO | 6.91  | 0.49 | 7.4  | 11 | Pass |
| NVNT | ac20 | 5300 | Ant1 | 4.21  | 0.49 | 4.7  | 11 | Pass |
| NVNT | ac20 | 5300 | Ant2 | 2.1   | 0.49 | 2.59 | 11 | Pass |
| NVNT | ac20 | 5300 | MIMO | 6.29  | 0.49 | 6.78 | 11 | Pass |
| NVNT | ac20 | 5320 | Ant1 | 4.46  | 0.48 | 4.94 | 11 | Pass |
| NVNT | ac20 | 5320 | Ant2 | 2.62  | 0.48 | 3.1  | 11 | Pass |
| NVNT | ac20 | 5320 | MIMO | 6.65  | 0.48 | 7.13 | 11 | Pass |
| NVNT | ac20 | 5500 | Ant1 | 4.08  | 0.49 | 4.57 | 11 | Pass |
| NVNT | ac20 | 5500 | Ant2 | 2.76  | 0.49 | 3.25 | 11 | Pass |
| NVNT | ac20 | 5500 | MIMO | 6.48  | 0.49 | 6.97 | 11 | Pass |
| NVNT | ac20 | 5580 | Ant1 | 3.29  | 0.48 | 3.77 | 11 | Pass |
| NVNT | ac20 | 5580 | Ant2 | 2.93  | 0.48 | 3.41 | 11 | Pass |
| NVNT | ac20 | 5580 | MIMO | 6.12  | 0.48 | 6.6  | 11 | Pass |
| NVNT | ac20 | 5700 | Ant1 | 2.64  | 0.48 | 3.12 | 11 | Pass |
| NVNT | ac20 | 5700 | Ant2 | 3.01  | 0.48 | 3.49 | 11 | Pass |
| NVNT | ac20 | 5700 | MIMO | 5.84  | 0.48 | 6.32 | 11 | Pass |
| NVNT | ac40 | 5190 | Ant1 | 2.16  | 0.86 | 3.02 | 11 | Pass |
| NVNT | ac40 | 5230 | Ant1 | 2.62  | 0.86 | 3.48 | 11 | Pass |
| NVNT | ac40 | 5270 | Ant1 | 3.28  | 0.84 | 4.12 | 11 | Pass |
| NVNT | ac40 | 5310 | Ant1 | 2.65  | 0.86 | 3.51 | 11 | Pass |
| NVNT | ac40 | 5510 | Ant1 | 1.73  | 0.86 | 2.59 | 11 | Pass |
| NVNT | ac40 | 5550 | Ant1 | 1.68  | 0.85 | 2.53 | 11 | Pass |
| NVNT | ac40 | 5670 | Ant1 | 1.9   | 0.86 | 2.76 | 11 | Pass |
| NVNT | ac40 | 5190 | Ant2 | 4.77  | 0.86 | 5.63 | 11 | Pass |
| NVNT | ac40 | 5230 | Ant2 | 2.38  | 0.86 | 3.24 | 11 | Pass |
| NVNT | ac40 | 5270 | Ant2 | 3.01  | 0.86 | 3.87 | 11 | Pass |
| NVNT | ac40 | 5310 | Ant2 | 2.62  | 0.86 | 3.48 | 11 | Pass |
| NVNT | ac40 | 5510 | Ant2 | 2.22  | 0.86 | 3.08 | 11 | Pass |
| NVNT | ac40 | 5550 | Ant2 | 2.66  | 0.86 | 3.52 | 11 | Pass |
| NVNT | ac40 | 5670 | Ant2 | 1.64  | 0.86 | 2.5  | 11 | Pass |
| NVNT | ac40 | 5190 | Ant1 | 2.29  | 0.86 | 3.15 | 11 | Pass |
| NVNT | ac40 | 5190 | Ant2 | -0.46 | 0.86 | 0.4  | 11 | Pass |
| NVNT | ac40 | 5190 | MIMO | 4.14  | 0.86 | 5    | 11 | Pass |
| NVNT | ac40 | 5230 | Ant1 | 3.1   | 0.86 | 3.96 | 11 | Pass |
| NVNT | ac40 | 5230 | Ant2 | 0.09  | 0.86 | 0.95 | 11 | Pass |
| NVNT | ac40 | 5230 | MIMO | 4.86  | 0.86 | 5.72 | 11 | Pass |



|      |       |      |      |       |      |       |    |      |
|------|-------|------|------|-------|------|-------|----|------|
| NVNT | ac40  | 5270 | Ant1 | 3.22  | 0.86 | 4.08  | 11 | Pass |
| NVNT | ac40  | 5270 | Ant2 | 0.63  | 0.86 | 1.49  | 11 | Pass |
| NVNT | ac40  | 5270 | MIMO | 5.13  | 0.86 | 5.99  | 11 | Pass |
| NVNT | ac40  | 5310 | Ant1 | 2.23  | 0.85 | 3.08  | 11 | Pass |
| NVNT | ac40  | 5310 | Ant2 | 0.23  | 0.85 | 1.08  | 11 | Pass |
| NVNT | ac40  | 5310 | MIMO | 4.35  | 0.85 | 5.2   | 11 | Pass |
| NVNT | ac40  | 5510 | Ant1 | 1.9   | 0.86 | 2.76  | 11 | Pass |
| NVNT | ac40  | 5510 | Ant2 | 0.63  | 0.86 | 1.49  | 11 | Pass |
| NVNT | ac40  | 5510 | MIMO | 4.32  | 0.86 | 5.18  | 11 | Pass |
| NVNT | ac40  | 5550 | Ant1 | 1.29  | 0.86 | 2.15  | 11 | Pass |
| NVNT | ac40  | 5550 | Ant2 | 0.88  | 0.86 | 1.74  | 11 | Pass |
| NVNT | ac40  | 5550 | MIMO | 4.1   | 0.86 | 4.96  | 11 | Pass |
| NVNT | ac40  | 5670 | Ant1 | 1.45  | 0.86 | 2.31  | 11 | Pass |
| NVNT | ac40  | 5670 | Ant2 | 0.27  | 0.86 | 1.13  | 11 | Pass |
| NVNT | ac40  | 5670 | MIMO | 3.91  | 0.86 | 4.77  | 11 | Pass |
| NVNT | ac80  | 5210 | Ant1 | 2.25  | 1.41 | 3.66  | 11 | Pass |
| NVNT | ac80  | 5290 | Ant1 | 2.5   | 1.41 | 3.91  | 11 | Pass |
| NVNT | ac80  | 5530 | Ant1 | 2.06  | 1.39 | 3.45  | 11 | Pass |
| NVNT | ac80  | 5610 | Ant1 | 0.85  | 1.41 | 2.26  | 11 | Pass |
| NVNT | ac80  | 5210 | Ant2 | 2.34  | 1.39 | 3.73  | 11 | Pass |
| NVNT | ac80  | 5290 | Ant2 | 2.06  | 1.41 | 3.47  | 11 | Pass |
| NVNT | ac80  | 5530 | Ant2 | 1.6   | 1.41 | 3.01  | 11 | Pass |
| NVNT | ac80  | 5610 | Ant2 | 1.73  | 1.41 | 3.14  | 11 | Pass |
| NVNT | ac80  | 5210 | Ant1 | -0.7  | 1.41 | 0.71  | 11 | Pass |
| NVNT | ac80  | 5210 | Ant2 | -3.46 | 1.41 | -2.05 | 11 | Pass |
| NVNT | ac80  | 5210 | MIMO | 1.15  | 1.41 | 2.56  | 11 | Pass |
| NVNT | ac80  | 5290 | Ant1 | -0.97 | 1.41 | 0.44  | 11 | Pass |
| NVNT | ac80  | 5290 | Ant2 | -3.16 | 1.41 | -1.75 | 11 | Pass |
| NVNT | ac80  | 5290 | MIMO | 1.08  | 1.41 | 2.49  | 11 | Pass |
| NVNT | ac80  | 5530 | Ant1 | -2.08 | 1.41 | -0.67 | 11 | Pass |
| NVNT | ac80  | 5530 | Ant2 | -2.77 | 1.41 | -1.36 | 11 | Pass |
| NVNT | ac80  | 5530 | MIMO | 0.6   | 1.41 | 2.01  | 11 | Pass |
| NVNT | ac80  | 5610 | Ant1 | -2.06 | 1.39 | -0.67 | 11 | Pass |
| NVNT | ac80  | 5610 | Ant2 | -2.23 | 1.39 | -0.84 | 11 | Pass |
| NVNT | ac80  | 5610 | MIMO | 0.87  | 1.39 | 2.26  | 11 | Pass |
| NVNT | ac160 | 5250 | Ant1 | -0.95 | 1.79 | 0.84  | 11 | Pass |
| NVNT | ac160 | 5570 | Ant1 | -1.88 | 1.76 | -0.12 | 11 | Pass |
| NVNT | ac160 | 5250 | Ant2 | -0.89 | 1.76 | 0.87  | 11 | Pass |
| NVNT | ac160 | 5570 | Ant2 | -1.67 | 1.75 | 0.08  | 11 | Pass |
| NVNT | ac160 | 5250 | Ant1 | -2.72 | 1.79 | -0.93 | 11 | Pass |
| NVNT | ac160 | 5250 | Ant2 | -5.87 | 1.79 | -4.08 | 11 | Pass |
| NVNT | ac160 | 5250 | MIMO | -1.01 | 1.79 | 0.78  | 11 | Pass |
| NVNT | ac160 | 5570 | Ant1 | -5.11 | 1.76 | -3.35 | 11 | Pass |
| NVNT | ac160 | 5570 | Ant2 | -5.49 | 1.76 | -3.73 | 11 | Pass |
| NVNT | ac160 | 5570 | MIMO | -2.29 | 1.76 | -0.53 | 11 | Pass |
| NVNT | ax20  | 5180 | Ant1 | 3.97  | 0.54 | 4.51  | 11 | Pass |
| NVNT | ax20  | 5200 | Ant1 | 4.15  | 0.54 | 4.69  | 11 | Pass |
| NVNT | ax20  | 5240 | Ant1 | 4.6   | 0.53 | 5.13  | 11 | Pass |
| NVNT | ax20  | 5260 | Ant1 | 4.96  | 0.53 | 5.49  | 11 | Pass |
| NVNT | ax20  | 5300 | Ant1 | 4.19  | 0.54 | 4.73  | 11 | Pass |
| NVNT | ax20  | 5320 | Ant1 | 4.27  | 0.54 | 4.81  | 11 | Pass |
| NVNT | ax20  | 5500 | Ant1 | 3.53  | 0.53 | 4.06  | 11 | Pass |
| NVNT | ax20  | 5580 | Ant1 | 3.24  | 0.54 | 3.78  | 11 | Pass |
| NVNT | ax20  | 5700 | Ant1 | 2.82  | 0.53 | 3.35  | 11 | Pass |
| NVNT | ax20  | 5180 | Ant2 | 5.27  | 0.54 | 5.81  | 11 | Pass |
| NVNT | ax20  | 5200 | Ant2 | 5.43  | 0.53 | 5.96  | 11 | Pass |



|      |      |      |      |       |      |      |    |      |
|------|------|------|------|-------|------|------|----|------|
| NVNT | ax20 | 5240 | Ant2 | 5.85  | 0.53 | 6.38 | 11 | Pass |
| NVNT | ax20 | 5260 | Ant2 | 6.16  | 0.54 | 6.7  | 11 | Pass |
| NVNT | ax20 | 5300 | Ant2 | 5.39  | 0.54 | 5.93 | 11 | Pass |
| NVNT | ax20 | 5320 | Ant2 | 5.43  | 0.54 | 5.97 | 11 | Pass |
| NVNT | ax20 | 5500 | Ant2 | 5.13  | 0.53 | 5.66 | 11 | Pass |
| NVNT | ax20 | 5580 | Ant2 | 5.32  | 0.53 | 5.85 | 11 | Pass |
| NVNT | ax20 | 5700 | Ant2 | 4.67  | 0.54 | 5.21 | 11 | Pass |
| NVNT | ax20 | 5180 | Ant1 | 3.96  | 0.53 | 4.49 | 11 | Pass |
| NVNT | ax20 | 5180 | Ant2 | 1.45  | 0.53 | 1.98 | 11 | Pass |
| NVNT | ax20 | 5180 | MIMO | 5.89  | 0.53 | 6.42 | 11 | Pass |
| NVNT | ax20 | 5200 | Ant1 | 4.48  | 0.54 | 5.02 | 11 | Pass |
| NVNT | ax20 | 5200 | Ant2 | 1.73  | 0.54 | 2.27 | 11 | Pass |
| NVNT | ax20 | 5200 | MIMO | 6.33  | 0.54 | 6.87 | 11 | Pass |
| NVNT | ax20 | 5240 | Ant1 | 4.8   | 0.54 | 5.34 | 11 | Pass |
| NVNT | ax20 | 5240 | Ant2 | 2.28  | 0.54 | 2.82 | 11 | Pass |
| NVNT | ax20 | 5240 | MIMO | 6.73  | 0.54 | 7.27 | 11 | Pass |
| NVNT | ax20 | 5260 | Ant1 | 4.91  | 0.54 | 5.45 | 11 | Pass |
| NVNT | ax20 | 5260 | Ant2 | 2.48  | 0.54 | 3.02 | 11 | Pass |
| NVNT | ax20 | 5260 | MIMO | 6.87  | 0.54 | 7.41 | 11 | Pass |
| NVNT | ax20 | 5300 | Ant1 | 4.22  | 0.54 | 4.76 | 11 | Pass |
| NVNT | ax20 | 5300 | Ant2 | 2.15  | 0.54 | 2.69 | 11 | Pass |
| NVNT | ax20 | 5300 | MIMO | 6.32  | 0.54 | 6.86 | 11 | Pass |
| NVNT | ax20 | 5320 | Ant1 | 4.17  | 0.53 | 4.7  | 11 | Pass |
| NVNT | ax20 | 5320 | Ant2 | 2.42  | 0.53 | 2.95 | 11 | Pass |
| NVNT | ax20 | 5320 | MIMO | 6.39  | 0.53 | 6.92 | 11 | Pass |
| NVNT | ax20 | 5500 | Ant1 | 3.7   | 0.54 | 4.24 | 11 | Pass |
| NVNT | ax20 | 5500 | Ant2 | 2.55  | 0.54 | 3.09 | 11 | Pass |
| NVNT | ax20 | 5500 | MIMO | 6.17  | 0.54 | 6.71 | 11 | Pass |
| NVNT | ax20 | 5580 | Ant1 | 2.95  | 0.54 | 3.49 | 11 | Pass |
| NVNT | ax20 | 5580 | Ant2 | 2.88  | 0.54 | 3.42 | 11 | Pass |
| NVNT | ax20 | 5580 | MIMO | 5.93  | 0.54 | 6.47 | 11 | Pass |
| NVNT | ax20 | 5700 | Ant1 | 2.54  | 0.54 | 3.08 | 11 | Pass |
| NVNT | ax20 | 5700 | Ant2 | 2.68  | 0.54 | 3.22 | 11 | Pass |
| NVNT | ax20 | 5700 | MIMO | 5.62  | 0.54 | 6.16 | 11 | Pass |
| NVNT | ax40 | 5190 | Ant1 | 2.58  | 0.55 | 3.13 | 11 | Pass |
| NVNT | ax40 | 5230 | Ant1 | 3.34  | 0.55 | 3.89 | 11 | Pass |
| NVNT | ax40 | 5270 | Ant1 | 3.68  | 0.55 | 4.23 | 11 | Pass |
| NVNT | ax40 | 5310 | Ant1 | 3.16  | 0.55 | 3.71 | 11 | Pass |
| NVNT | ax40 | 5510 | Ant1 | 2.3   | 0.55 | 2.85 | 11 | Pass |
| NVNT | ax40 | 5550 | Ant1 | 2.34  | 0.55 | 2.89 | 11 | Pass |
| NVNT | ax40 | 5670 | Ant1 | 2.43  | 0.55 | 2.98 | 11 | Pass |
| NVNT | ax40 | 5190 | Ant2 | 4.21  | 0.55 | 4.76 | 11 | Pass |
| NVNT | ax40 | 5230 | Ant2 | 4.73  | 0.54 | 5.27 | 11 | Pass |
| NVNT | ax40 | 5270 | Ant2 | 4.91  | 0.55 | 5.46 | 11 | Pass |
| NVNT | ax40 | 5310 | Ant2 | 4.36  | 0.55 | 4.91 | 11 | Pass |
| NVNT | ax40 | 5510 | Ant2 | 3.75  | 0.55 | 4.3  | 11 | Pass |
| NVNT | ax40 | 5550 | Ant2 | 4.2   | 0.55 | 4.75 | 11 | Pass |
| NVNT | ax40 | 5670 | Ant2 | 3.08  | 0.55 | 3.63 | 11 | Pass |
| NVNT | ax40 | 5190 | Ant1 | 2.77  | 0.55 | 3.32 | 11 | Pass |
| NVNT | ax40 | 5190 | Ant2 | -0.02 | 0.55 | 0.53 | 11 | Pass |
| NVNT | ax40 | 5190 | MIMO | 4.61  | 0.55 | 5.16 | 11 | Pass |
| NVNT | ax40 | 5230 | Ant1 | 3.47  | 0.55 | 4.02 | 11 | Pass |
| NVNT | ax40 | 5230 | Ant2 | 0.64  | 0.55 | 1.19 | 11 | Pass |
| NVNT | ax40 | 5230 | MIMO | 5.29  | 0.55 | 5.84 | 11 | Pass |
| NVNT | ax40 | 5270 | Ant1 | 3.67  | 0.55 | 4.22 | 11 | Pass |
| NVNT | ax40 | 5270 | Ant2 | 1.15  | 0.55 | 1.7  | 11 | Pass |



|      |       |      |      |       |      |       |    |      |
|------|-------|------|------|-------|------|-------|----|------|
| NVNT | ax40  | 5270 | MIMO | 5.6   | 0.55 | 6.15  | 11 | Pass |
| NVNT | ax40  | 5310 | Ant1 | 2.9   | 0.54 | 3.44  | 11 | Pass |
| NVNT | ax40  | 5310 | Ant2 | 0.93  | 0.54 | 1.47  | 11 | Pass |
| NVNT | ax40  | 5310 | MIMO | 5.04  | 0.54 | 5.58  | 11 | Pass |
| NVNT | ax40  | 5510 | Ant1 | 2.44  | 0.55 | 2.99  | 11 | Pass |
| NVNT | ax40  | 5510 | Ant2 | 1.14  | 0.55 | 1.69  | 11 | Pass |
| NVNT | ax40  | 5510 | MIMO | 4.85  | 0.55 | 5.4   | 11 | Pass |
| NVNT | ax40  | 5550 | Ant1 | 2.01  | 0.55 | 2.56  | 11 | Pass |
| NVNT | ax40  | 5550 | Ant2 | 1.37  | 0.55 | 1.92  | 11 | Pass |
| NVNT | ax40  | 5550 | MIMO | 4.71  | 0.55 | 5.26  | 11 | Pass |
| NVNT | ax40  | 5670 | Ant1 | 2.18  | 0.55 | 2.73  | 11 | Pass |
| NVNT | ax40  | 5670 | Ant2 | 1.06  | 0.55 | 1.61  | 11 | Pass |
| NVNT | ax40  | 5670 | MIMO | 4.67  | 0.55 | 5.22  | 11 | Pass |
| NVNT | ax80  | 5210 | Ant1 | -0.4  | 0.56 | 0.16  | 11 | Pass |
| NVNT | ax80  | 5290 | Ant1 | -0.1  | 0.56 | 0.46  | 11 | Pass |
| NVNT | ax80  | 5530 | Ant1 | -0.99 | 0.56 | -0.43 | 11 | Pass |
| NVNT | ax80  | 5610 | Ant1 | -1.45 | 0.56 | -0.89 | 11 | Pass |
| NVNT | ax80  | 5210 | Ant2 | 0.82  | 0.56 | 1.38  | 11 | Pass |
| NVNT | ax80  | 5290 | Ant2 | 0.72  | 0.55 | 1.27  | 11 | Pass |
| NVNT | ax80  | 5530 | Ant2 | 0.18  | 0.56 | 0.74  | 11 | Pass |
| NVNT | ax80  | 5610 | Ant2 | 1     | 0.56 | 1.56  | 11 | Pass |
| NVNT | ax80  | 5210 | Ant1 | -0.52 | 0.56 | 0.04  | 11 | Pass |
| NVNT | ax80  | 5210 | Ant2 | -2.8  | 0.56 | -2.24 | 11 | Pass |
| NVNT | ax80  | 5210 | MIMO | 1.5   | 0.56 | 2.06  | 11 | Pass |
| NVNT | ax80  | 5290 | Ant1 | -0.77 | 0.56 | -0.21 | 11 | Pass |
| NVNT | ax80  | 5290 | Ant2 | -2.81 | 0.56 | -2.25 | 11 | Pass |
| NVNT | ax80  | 5290 | MIMO | 1.34  | 0.56 | 1.9   | 11 | Pass |
| NVNT | ax80  | 5530 | Ant1 | -1.6  | 0.56 | -1.04 | 11 | Pass |
| NVNT | ax80  | 5530 | Ant2 | -2.41 | 0.56 | -1.85 | 11 | Pass |
| NVNT | ax80  | 5530 | MIMO | 1.02  | 0.56 | 1.58  | 11 | Pass |
| NVNT | ax80  | 5610 | Ant2 | -1.77 | 0.56 | -1.21 | 11 | Pass |
| NVNT | ax80  | 5610 | MIMO | 1.4   | 0.56 | 1.96  | 11 | Pass |
| NVNT | ax160 | 5250 | Ant1 | -3.04 | 0.51 | -2.53 | 11 | Pass |
| NVNT | ax160 | 5570 | Ant1 | -4.48 | 1.29 | -3.19 | 11 | Pass |
| NVNT | ax160 | 5250 | Ant2 | -2.17 | 0.5  | -1.67 | 11 | Pass |
| NVNT | ax160 | 5570 | Ant2 | -2.83 | 0.51 | -2.32 | 11 | Pass |
| NVNT | ax160 | 5250 | Ant2 | -5.78 | 0.51 | -5.27 | 11 | Pass |
| NVNT | ax160 | 5250 | MIMO | -1.19 | 0.51 | -0.68 | 11 | Pass |
| NVNT | ax160 | 5570 | Ant1 | -4.98 | 0.51 | -4.47 | 11 | Pass |
| NVNT | ax160 | 5570 | Ant2 | -5.5  | 0.51 | -4.99 | 11 | Pass |
| NVNT | ax160 | 5570 | MIMO | -2.22 | 0.51 | -1.71 | 11 | Pass |

| Condition | Mode | Frequency (MHz) | Antenna | Conducted PSD (dBm/500kHz) | Duty Factor (dB) | Total PSD (dBm/500kHz) | Limit (dBm/500kHz) | Verdict |
|-----------|------|-----------------|---------|----------------------------|------------------|------------------------|--------------------|---------|
| NVNT      | a    | 5745            | Ant1    | 1.29                       | 0.17             | 1.46                   | 30                 | Pass    |
| NVNT      | a    | 5785            | Ant1    | 1.96                       | 0.17             | 2.13                   | 30                 | Pass    |
| NVNT      | a    | 5825            | Ant1    | 1.71                       | 0.17             | 1.88                   | 30                 | Pass    |
| NVNT      | a    | 5745            | Ant2    | 2.44                       | 0.17             | 2.61                   | 30                 | Pass    |
| NVNT      | a    | 5785            | Ant2    | 2.66                       | 0.17             | 2.83                   | 30                 | Pass    |
| NVNT      | a    | 5825            | Ant2    | 1.8                        | 0.17             | 1.97                   | 30                 | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 1.3                        | 0.19             | 1.49                   | 30                 | Pass    |
| NVNT      | n20  | 5785            | Ant1    | 1.61                       | 0.19             | 1.8                    | 30                 | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 1.17                       | 0.19             | 1.36                   | 30                 | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 2.1                        | 0.19             | 2.29                   | 30                 | Pass    |



|      |      |      |      |       |      |       |    |      |
|------|------|------|------|-------|------|-------|----|------|
| NVNT | n20  | 5785 | Ant2 | 2.22  | 0.18 | 2.4   | 30 | Pass |
| NVNT | n20  | 5825 | Ant2 | 1.49  | 0.19 | 1.68  | 30 | Pass |
| NVNT | n20  | 5745 | Ant1 | 1.22  | 0.19 | 1.41  | 30 | Pass |
| NVNT | n20  | 5745 | Ant2 | 1.08  | 0.19 | 1.27  | 30 | Pass |
| NVNT | n20  | 5745 | MIMO | 4.16  | 0.19 | 4.35  | 30 | Pass |
| NVNT | n20  | 5785 | Ant1 | 1.92  | 0.19 | 2.11  | 30 | Pass |
| NVNT | n20  | 5785 | Ant2 | 1.29  | 0.19 | 1.48  | 30 | Pass |
| NVNT | n20  | 5785 | MIMO | 4.63  | 0.19 | 4.82  | 30 | Pass |
| NVNT | n20  | 5825 | Ant1 | 1.28  | 0.19 | 1.47  | 30 | Pass |
| NVNT | n20  | 5825 | Ant2 | 0.43  | 0.19 | 0.62  | 30 | Pass |
| NVNT | n20  | 5825 | MIMO | 3.89  | 0.19 | 4.08  | 30 | Pass |
| NVNT | n40  | 5755 | Ant1 | -0.39 | 0.36 | -0.03 | 30 | Pass |
| NVNT | n40  | 5795 | Ant1 | -0.06 | 0.37 | 0.31  | 30 | Pass |
| NVNT | n40  | 5755 | Ant2 | 0.22  | 0.37 | 0.59  | 30 | Pass |
| NVNT | n40  | 5795 | Ant2 | 0.56  | 0.37 | 0.93  | 30 | Pass |
| NVNT | n40  | 5755 | Ant1 | -0.76 | 0.36 | -0.4  | 30 | Pass |
| NVNT | n40  | 5755 | Ant2 | -1.25 | 0.36 | -0.89 | 30 | Pass |
| NVNT | n40  | 5755 | MIMO | 2.01  | 0.36 | 2.37  | 30 | Pass |
| NVNT | n40  | 5795 | Ant1 | -0.2  | 0.37 | 0.17  | 30 | Pass |
| NVNT | n40  | 5795 | Ant2 | -0.64 | 0.37 | -0.27 | 30 | Pass |
| NVNT | n40  | 5795 | MIMO | 2.6   | 0.37 | 2.97  | 30 | Pass |
| NVNT | ac20 | 5745 | Ant1 | 0.75  | 0.49 | 1.24  | 30 | Pass |
| NVNT | ac20 | 5785 | Ant1 | 1.5   | 0.49 | 1.99  | 30 | Pass |
| NVNT | ac20 | 5825 | Ant1 | 1.06  | 0.49 | 1.55  | 30 | Pass |
| NVNT | ac20 | 5745 | Ant2 | 1.85  | 0.49 | 2.34  | 30 | Pass |
| NVNT | ac20 | 5785 | Ant2 | 2.33  | 0.49 | 2.82  | 30 | Pass |
| NVNT | ac20 | 5825 | Ant2 | 1.5   | 0.49 | 1.99  | 30 | Pass |
| NVNT | ac20 | 5745 | Ant1 | 0.85  | 0.49 | 1.34  | 30 | Pass |
| NVNT | ac20 | 5745 | Ant2 | 0.82  | 0.49 | 1.31  | 30 | Pass |
| NVNT | ac20 | 5745 | MIMO | 3.85  | 0.49 | 4.34  | 30 | Pass |
| NVNT | ac20 | 5785 | Ant1 | 1.43  | 0.49 | 1.92  | 30 | Pass |
| NVNT | ac20 | 5785 | Ant2 | 0.95  | 0.49 | 1.44  | 30 | Pass |
| NVNT | ac20 | 5785 | MIMO | 4.21  | 0.49 | 4.7   | 30 | Pass |
| NVNT | ac20 | 5825 | Ant1 | 1.25  | 0.48 | 1.73  | 30 | Pass |
| NVNT | ac20 | 5825 | Ant2 | 0.3   | 0.48 | 0.78  | 30 | Pass |
| NVNT | ac20 | 5825 | MIMO | 3.81  | 0.48 | 4.29  | 30 | Pass |
| NVNT | ac40 | 5755 | Ant1 | -0.79 | 0.86 | 0.07  | 30 | Pass |
| NVNT | ac40 | 5795 | Ant1 | -0.1  | 0.86 | 0.76  | 30 | Pass |
| NVNT | ac40 | 5755 | Ant2 | 1.87  | 0.86 | 2.73  | 30 | Pass |
| NVNT | ac40 | 5795 | Ant2 | 0.01  | 0.86 | 0.87  | 30 | Pass |
| NVNT | ac40 | 5755 | Ant1 | -1.13 | 0.86 | -0.27 | 30 | Pass |
| NVNT | ac40 | 5755 | Ant2 | -1.36 | 0.86 | -0.5  | 30 | Pass |
| NVNT | ac40 | 5755 | MIMO | 1.77  | 0.86 | 2.63  | 30 | Pass |
| NVNT | ac40 | 5795 | Ant1 | -0.41 | 0.86 | 0.45  | 30 | Pass |
| NVNT | ac40 | 5795 | Ant2 | -1.25 | 0.86 | -0.39 | 30 | Pass |
| NVNT | ac40 | 5795 | MIMO | 2.2   | 0.86 | 3.06  | 30 | Pass |
| NVNT | ac80 | 5775 | Ant1 | -0.4  | 1.41 | 1.01  | 30 | Pass |
| NVNT | ac80 | 5775 | Ant2 | -0.26 | 1.41 | 1.15  | 30 | Pass |
| NVNT | ac80 | 5775 | Ant1 | -4.34 | 1.41 | -2.93 | 30 | Pass |
| NVNT | ac80 | 5775 | Ant2 | -4.48 | 1.41 | -3.07 | 30 | Pass |
| NVNT | ac80 | 5775 | MIMO | -1.4  | 1.41 | 0.01  | 30 | Pass |
| NVNT | ax20 | 5745 | Ant1 | 0.99  | 0.54 | 1.53  | 30 | Pass |
| NVNT | ax20 | 5785 | Ant1 | 1.42  | 0.54 | 1.96  | 30 | Pass |
| NVNT | ax20 | 5825 | Ant1 | 0.88  | 0.54 | 1.42  | 30 | Pass |
| NVNT | ax20 | 5745 | Ant2 | 2.93  | 0.54 | 3.47  | 30 | Pass |
| NVNT | ax20 | 5785 | Ant2 | 3.09  | 0.54 | 3.63  | 30 | Pass |



|      |      |      |      |       |      |       |    |      |
|------|------|------|------|-------|------|-------|----|------|
| NVNT | ax20 | 5825 | Ant2 | 2.5   | 0.54 | 3.04  | 30 | Pass |
| NVNT | ax20 | 5745 | Ant1 | 1.18  | 0.53 | 1.71  | 30 | Pass |
| NVNT | ax20 | 5745 | Ant2 | 0.76  | 0.53 | 1.29  | 30 | Pass |
| NVNT | ax20 | 5745 | MIMO | 3.99  | 0.53 | 4.52  | 30 | Pass |
| NVNT | ax20 | 5785 | Ant1 | 1.52  | 0.54 | 2.06  | 30 | Pass |
| NVNT | ax20 | 5785 | Ant2 | 0.87  | 0.54 | 1.41  | 30 | Pass |
| NVNT | ax20 | 5785 | MIMO | 4.22  | 0.54 | 4.76  | 30 | Pass |
| NVNT | ax20 | 5825 | Ant1 | 1.18  | 0.53 | 1.71  | 30 | Pass |
| NVNT | ax20 | 5825 | Ant2 | 0.08  | 0.53 | 0.61  | 30 | Pass |
| NVNT | ax20 | 5825 | MIMO | 3.68  | 0.53 | 4.21  | 30 | Pass |
| NVNT | ax40 | 5755 | Ant1 | -0.15 | 0.55 | 0.4   | 30 | Pass |
| NVNT | ax40 | 5795 | Ant1 | 0.06  | 0.55 | 0.61  | 30 | Pass |
| NVNT | ax40 | 5755 | Ant2 | 1.96  | 0.55 | 2.51  | 30 | Pass |
| NVNT | ax40 | 5795 | Ant2 | 1.88  | 0.55 | 2.43  | 30 | Pass |
| NVNT | ax40 | 5755 | Ant1 | -0.66 | 0.55 | -0.11 | 30 | Pass |
| NVNT | ax40 | 5755 | Ant2 | -0.68 | 0.55 | -0.13 | 30 | Pass |
| NVNT | ax40 | 5755 | MIMO | 2.34  | 0.55 | 2.89  | 30 | Pass |
| NVNT | ax40 | 5795 | Ant1 | -0.06 | 0.55 | 0.49  | 30 | Pass |
| NVNT | ax40 | 5795 | Ant2 | -0.7  | 0.55 | -0.15 | 30 | Pass |
| NVNT | ax40 | 5795 | MIMO | 2.64  | 0.55 | 3.19  | 30 | Pass |
| NVNT | ax80 | 5775 | Ant1 | -3.5  | 0.56 | -2.94 | 30 | Pass |
| NVNT | ax80 | 5775 | Ant2 | -1.32 | 0.56 | -0.76 | 30 | Pass |
| NVNT | ax80 | 5775 | Ant1 | -3.71 | 0.56 | -3.15 | 30 | Pass |
| NVNT | ax80 | 5775 | Ant2 | -3.91 | 0.56 | -3.35 | 30 | Pass |
| NVNT | ax80 | 5775 | MIMO | -0.8  | 0.56 | -0.24 | 30 | Pass |

