




1: Please verify the measured level of the fundamental. It seems low. If the level of the fundamental is verified to be correct, the level of spurious emissions cannot be higher than the level of the fundamental. Please verify the levels of the spurious emissions.

As type error in original report, please refer to below correct test data.

Now we have revised page 8 of test report.

Amendment report downloaded to web site.

Data: 3 File: C:\RE Data\client data\SHANTOU CHENGHAI DONGXIN PLASTIC TOYS CO.,LTD.EMI (6
Level (dBuV/m) Date: 2006-08-29 Time: 13:43:40

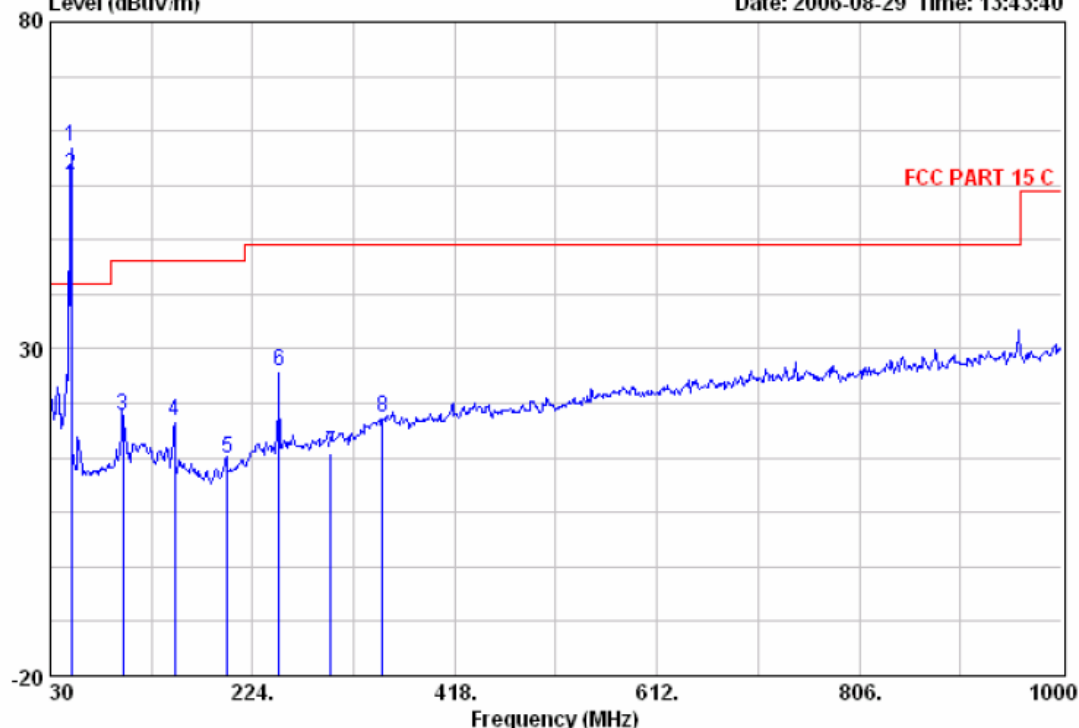

	Freq	ReadAntenna	Cable	Preamp		Limit	Over	
	Level	Factor	Loss	Factor	Level	Line	Limit	Remark
	MHz	dBuV	dB/m	dB	dB	dBuV/m	dBuV/m	dB
1 Max	49.860	72.77	12.75	0.70	25.30	60.92	40.00	20.92 PEAK
2 Max	49.860	68.41	12.75	0.70	25.30	56.55	40.00	16.55 AVERAGE
3	99.720	33.77	10.29	0.90	25.10	19.86	43.50	-23.64 QP
4	149.580	32.19	10.72	1.10	24.91	19.10	43.50	-24.40 QP
5	199.440	27.51	9.17	1.30	24.61	13.37	43.50	-30.13 QP
6	249.300	36.83	12.54	1.50	24.40	26.46	46.00	-19.54 QP
7	299.160	22.95	13.95	1.60	24.40	14.10	46.00	-31.90 QP
8	349.020	25.68	16.75	1.76	24.71	19.47	46.00	-26.53 QP