

Report No.: 0600342
DVD Playing mode
(Modulating on)
AC Mains

Tested By: Hong, Report No.: 0600342

Scan Settings (1 Range)

|----- Frequencies -----||----- Receiver Settings -----|

Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
150k	30M	5k	10k	PK+AV	10ms	AUTO	LN OFF	60dB

Final Measurement: x QP / + AV

Meas Time: 1 s


Subranges: 16

Acc Margin: 20dB

Transducer No.	Start	Stop	Name
----------------	-------	------	------

1	15	9k	30M	EW0090
---	----	----	-----	--------

21	9k	30M	EW0698
----	----	-----	--------

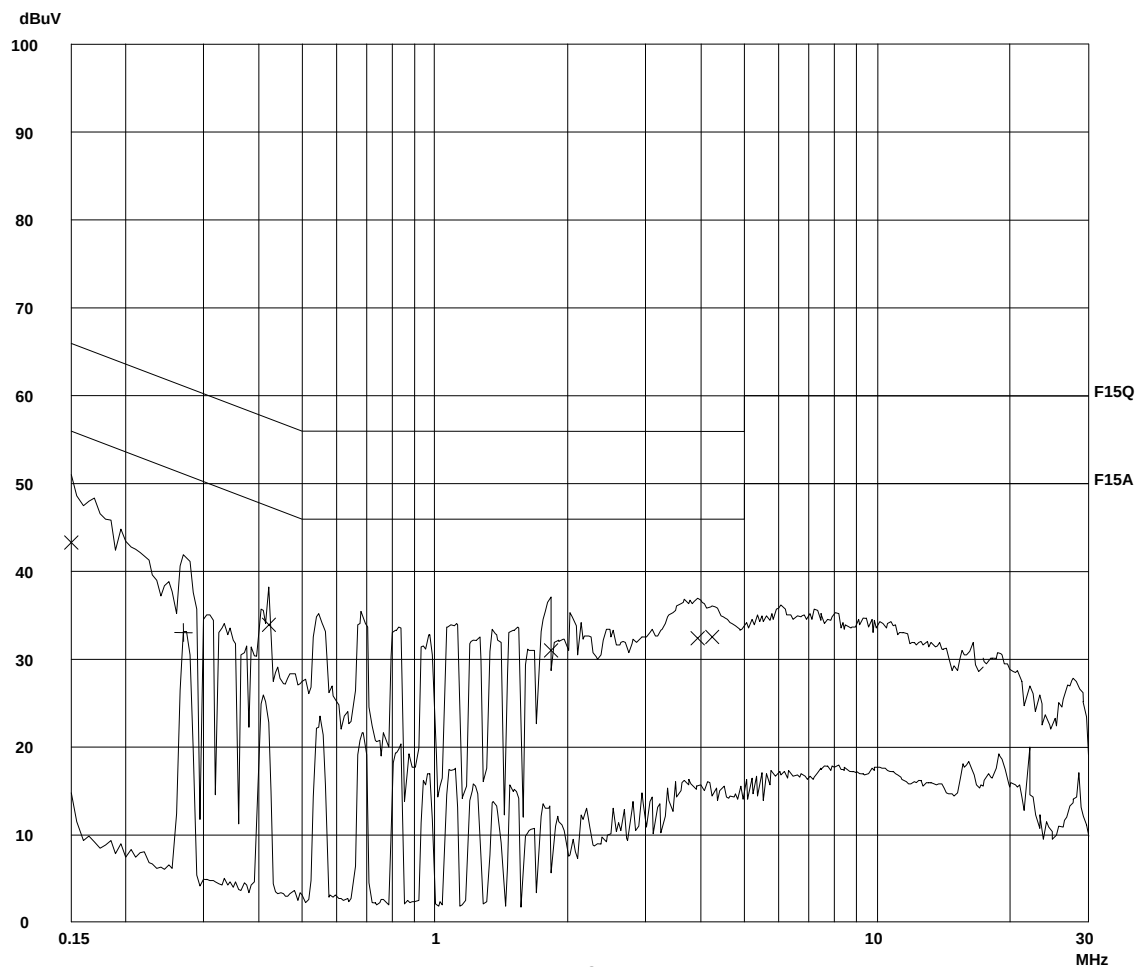

Ctrl No.:

Report No.: 0600342
DVD Playing mode
(Modulating on)
AC Mains

Tested By: Hong, Report No.: 0600342

Scan Settings (1 Range)

|----- Frequencies -----||----- Receiver Settings -----|

Start	Stop	Step	IF BW	Detector	M-Time	Atten	Preamp	OpRge
150k	30M	5k	10k	PK+AV	10ms	AUTO	LN OFF	60dB

Final Measurement Results:

Frequency	QP Level	QP Limit
MHz	dBuV	dBuV

0.15000	43.2	66.0
0.42000	33.9	57.5
1.83000	31.0	56.0
3.92500	32.3	56.0
4.22500	32.4	56.0

Frequency	AV Level	AV Limit
MHz	dBuV	dBuV

0.27000	33.0	51.1
---------	------	------

* limit

Ctrl No.: