


Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303


Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11g	Frequency	TX 2462MHz
Simultaneous Factor	10 log(n) (Note: "n" is antenna number)		3

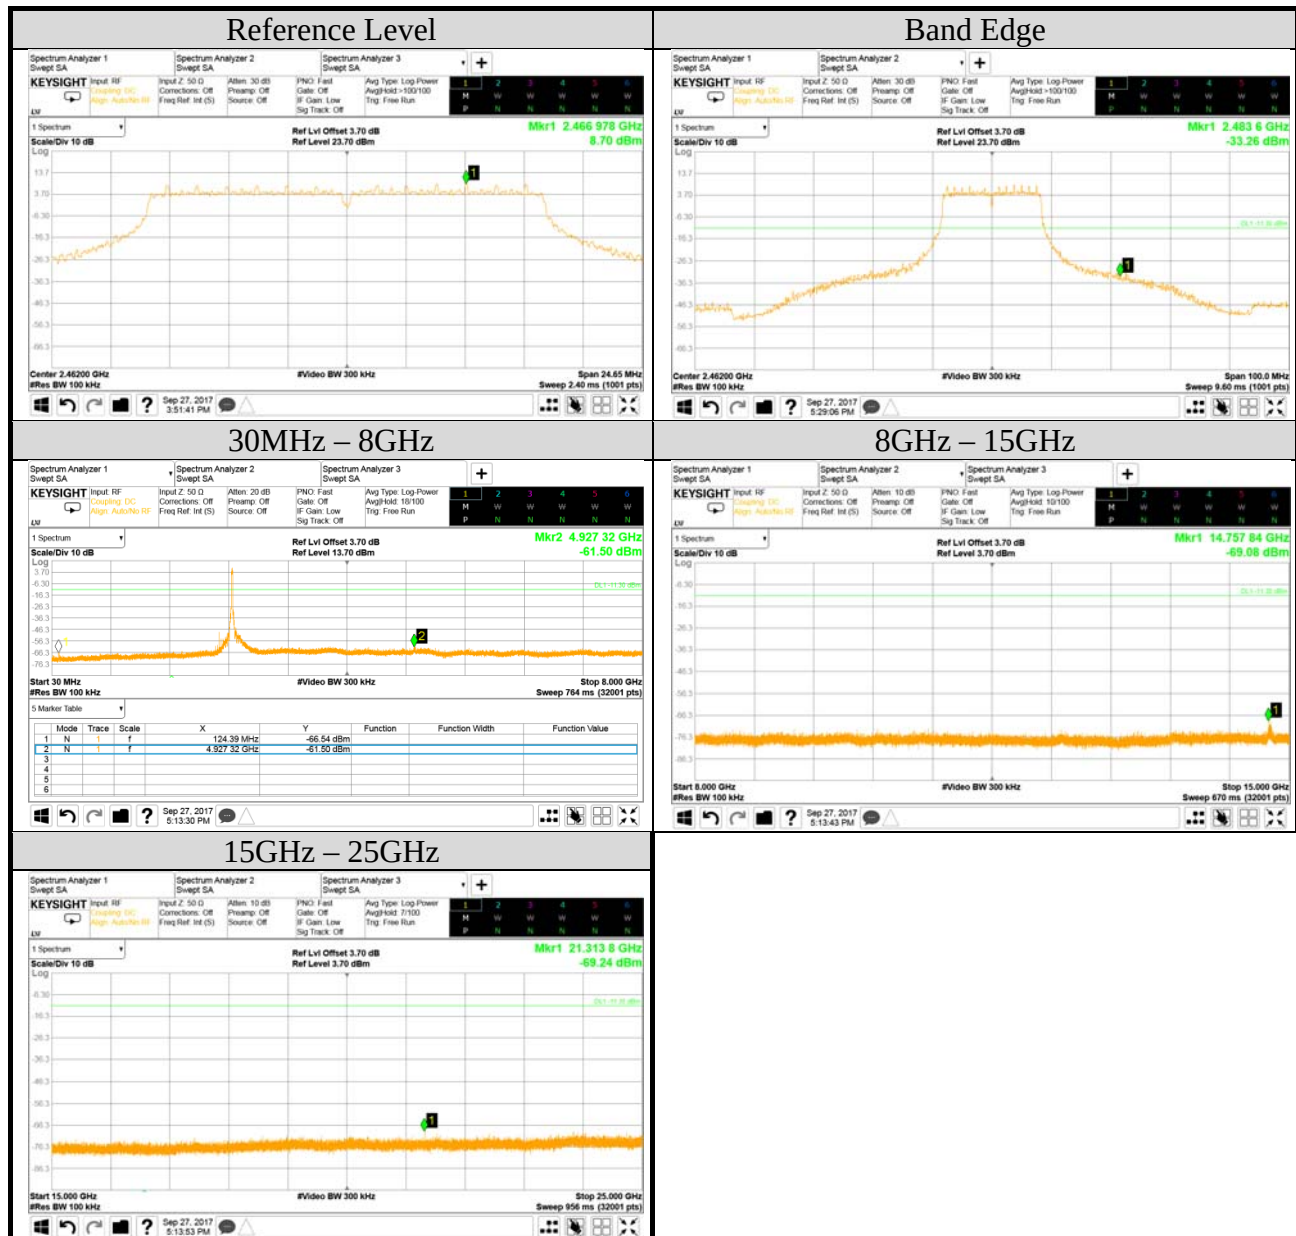

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303


Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11n-HT20	Frequency	TX 2412MHz
Simultaneous Factor10 log(n) (Note: "n" is antenna number)			3

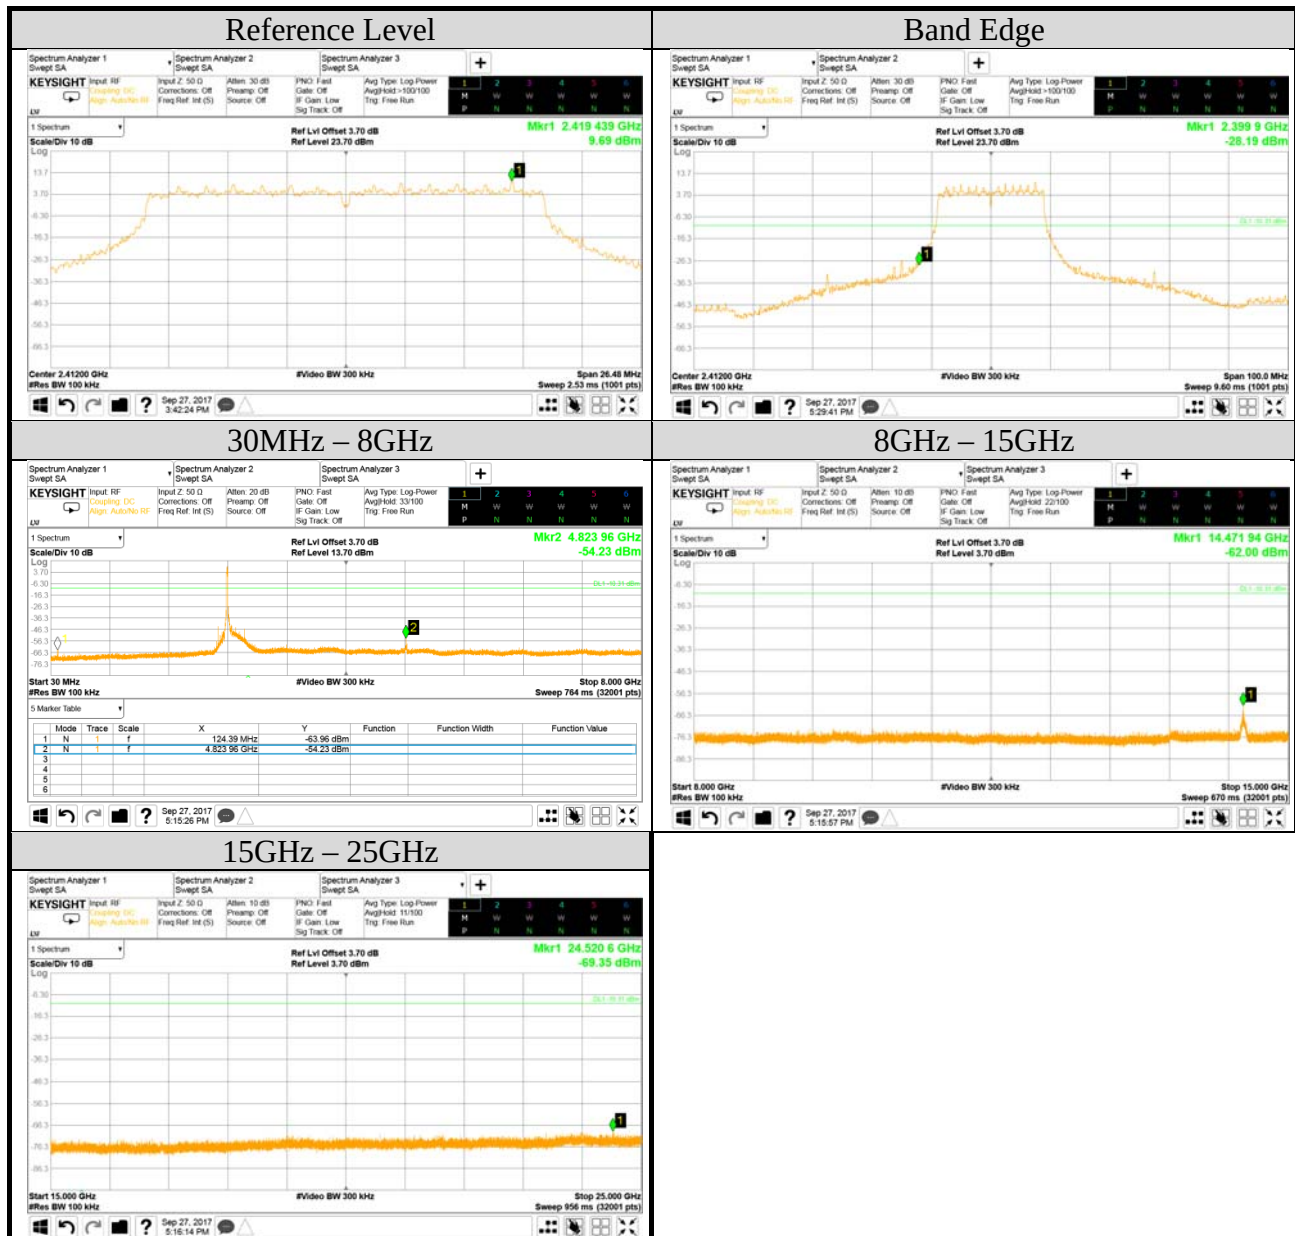

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303


Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11n-HT20	Frequency	TX 2437MHz
Simultaneous Factor10 log(n) (Note: “n” is antenna number)			3

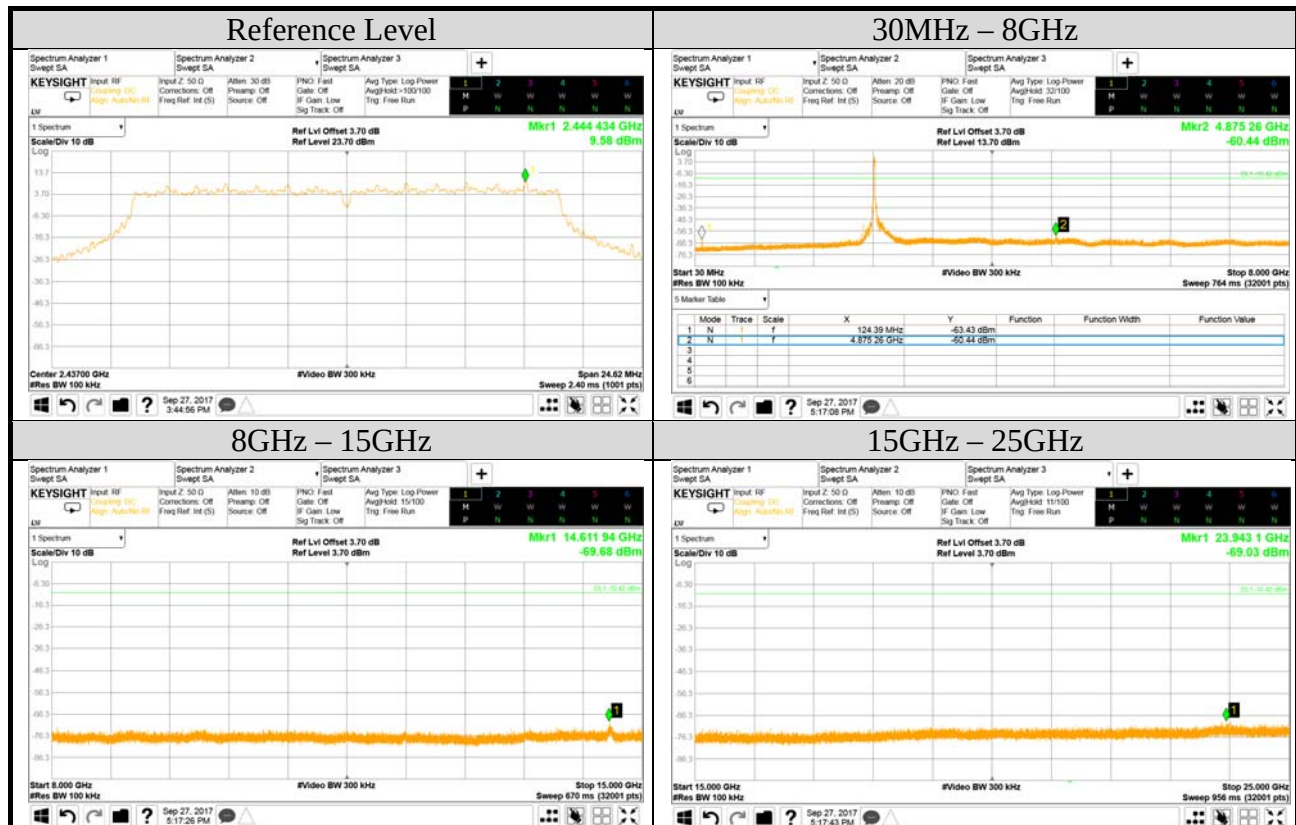

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11n-HT20	Frequency	TX 2462MHz
Simultaneous Factor	10 log(n) (Note: "n" is antenna number)		3

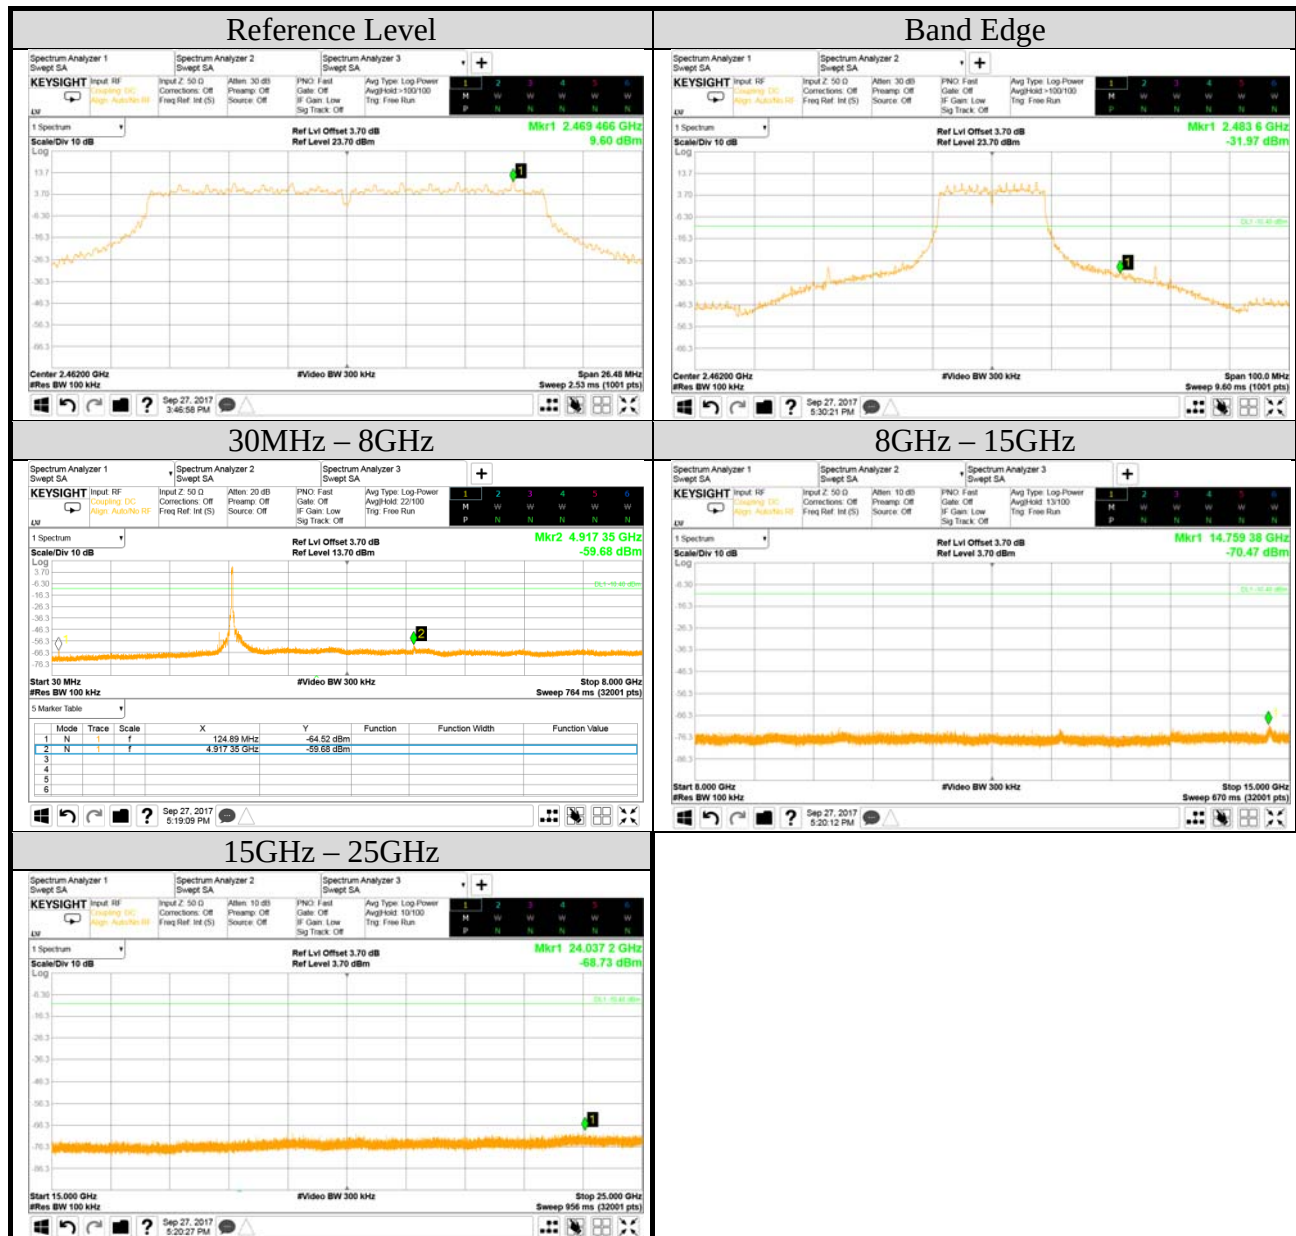


Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

● Antenna: Omni-S Antenna


Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11b	Frequency	TX 2412MHz
Simultaneous Factor10 log(n) (Note: “n” is antenna number)	0		

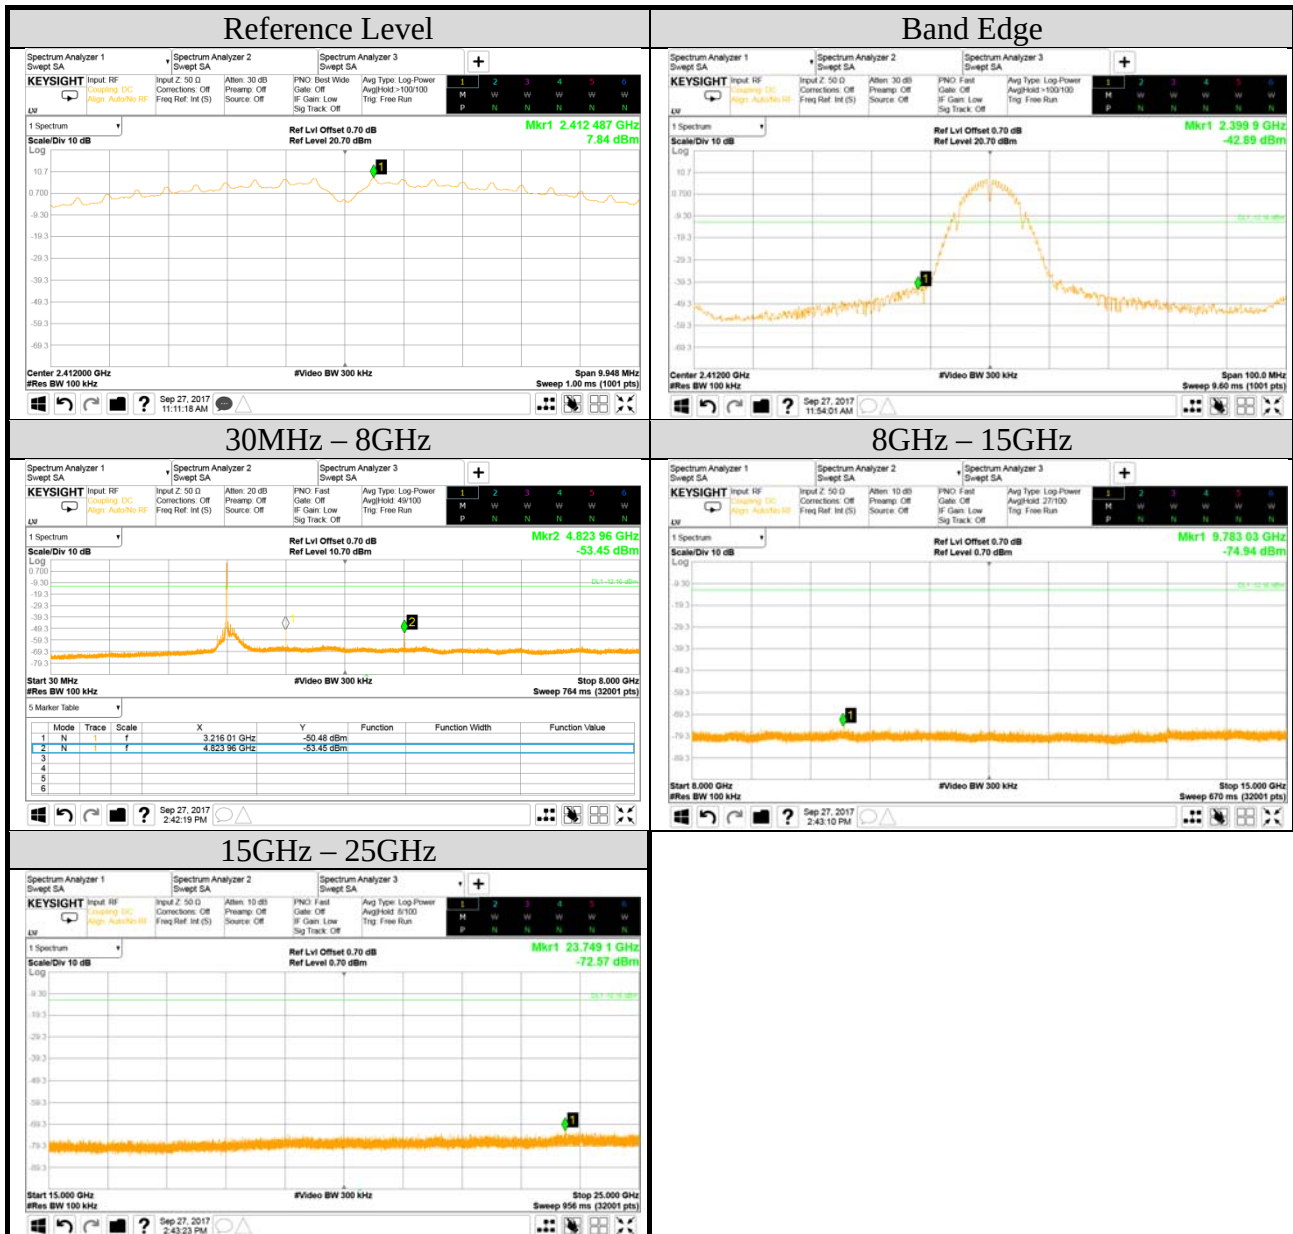

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303


Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11b	Frequency	TX 2437MHz
Simultaneous Factor10 log(n) (Note: “n” is antenna number)		0	

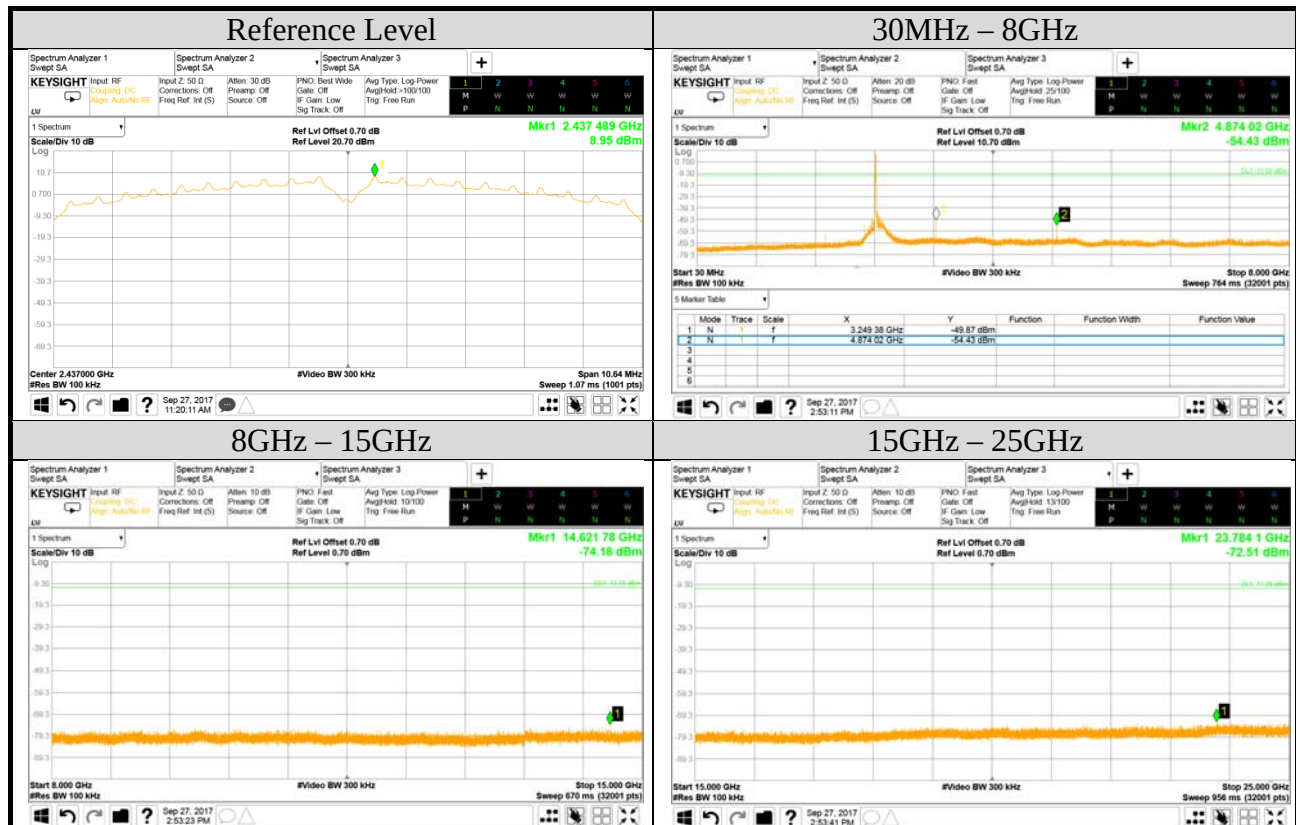

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303


Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11b	Frequency	TX 2462MHz
Simultaneous Factor	10 log(n) (Note: “n” is antenna number)		0

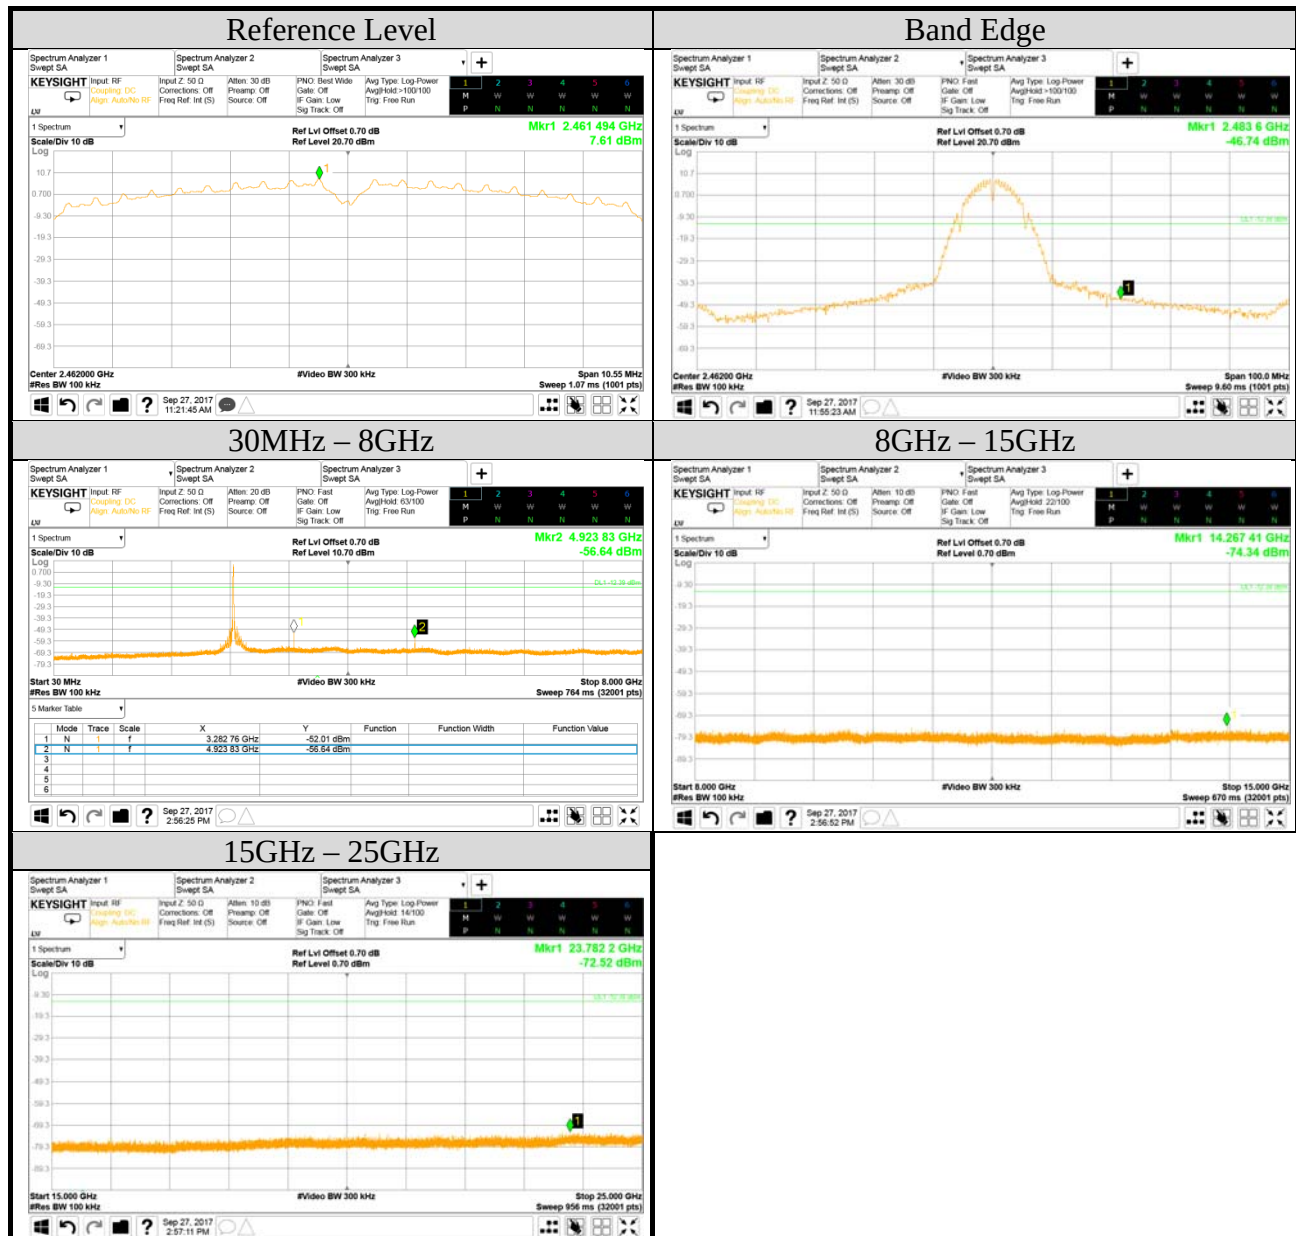

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303


Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11g	Frequency	TX 2412MHz
Simultaneous Factor10 log(n) (Note: “n” is antenna number)			0

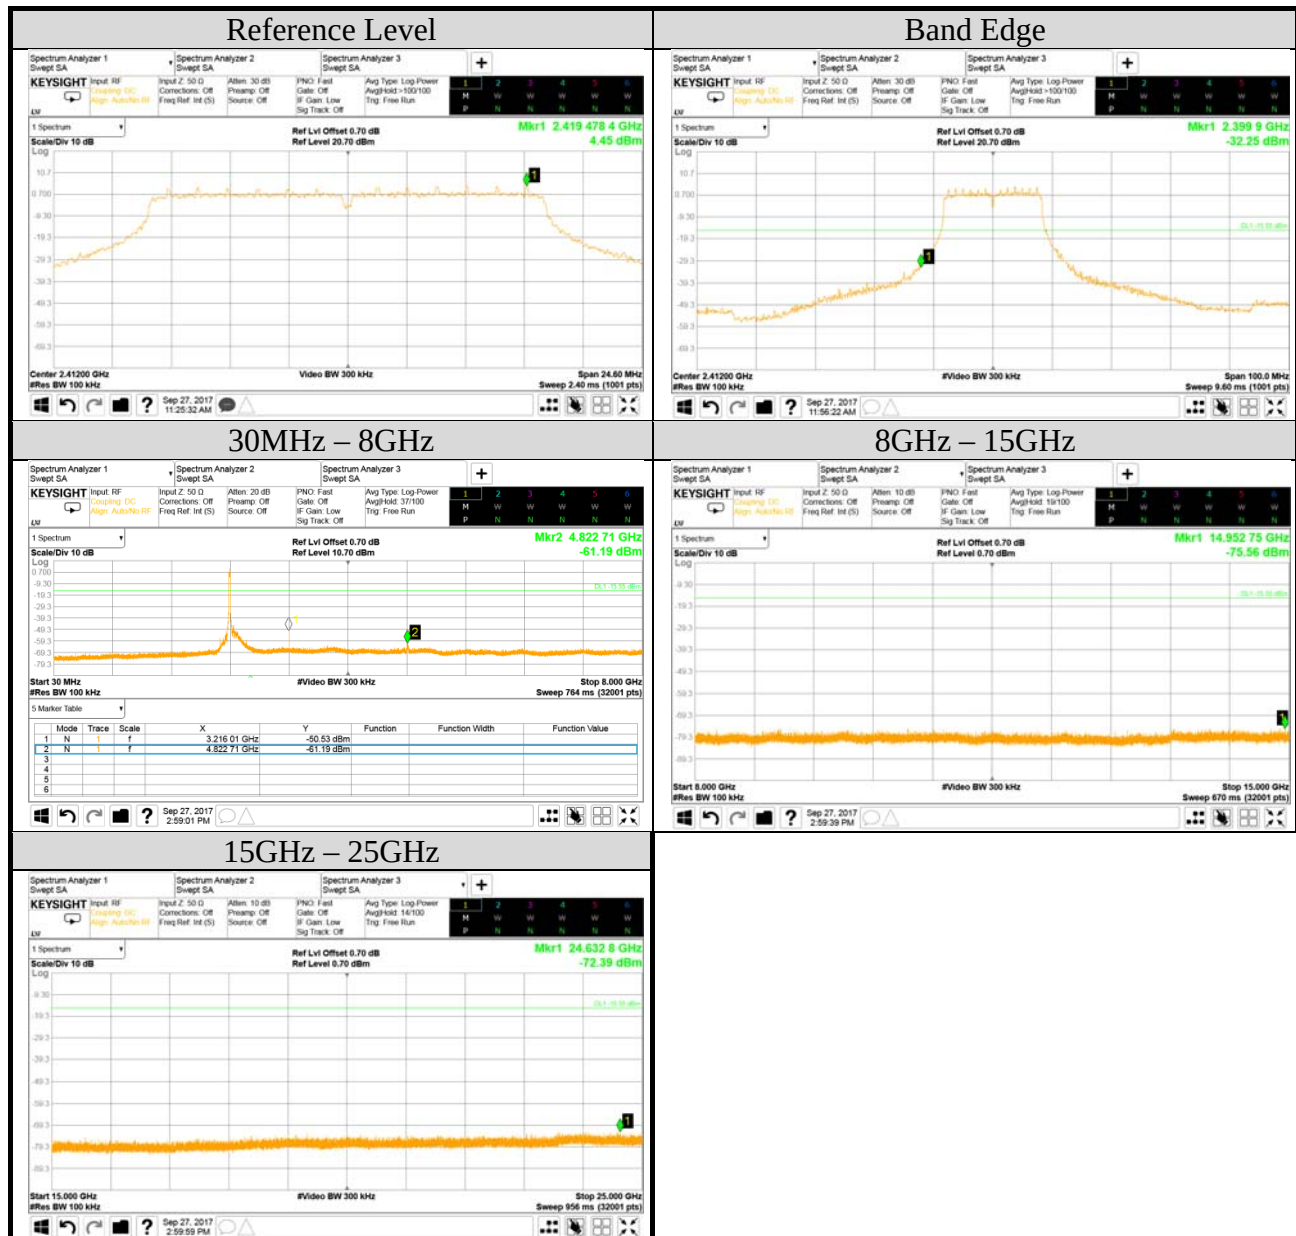

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303


Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11g	Frequency	TX 2437MHz
Simultaneous Factor10 log(n) (Note: “n” is antenna number)			0

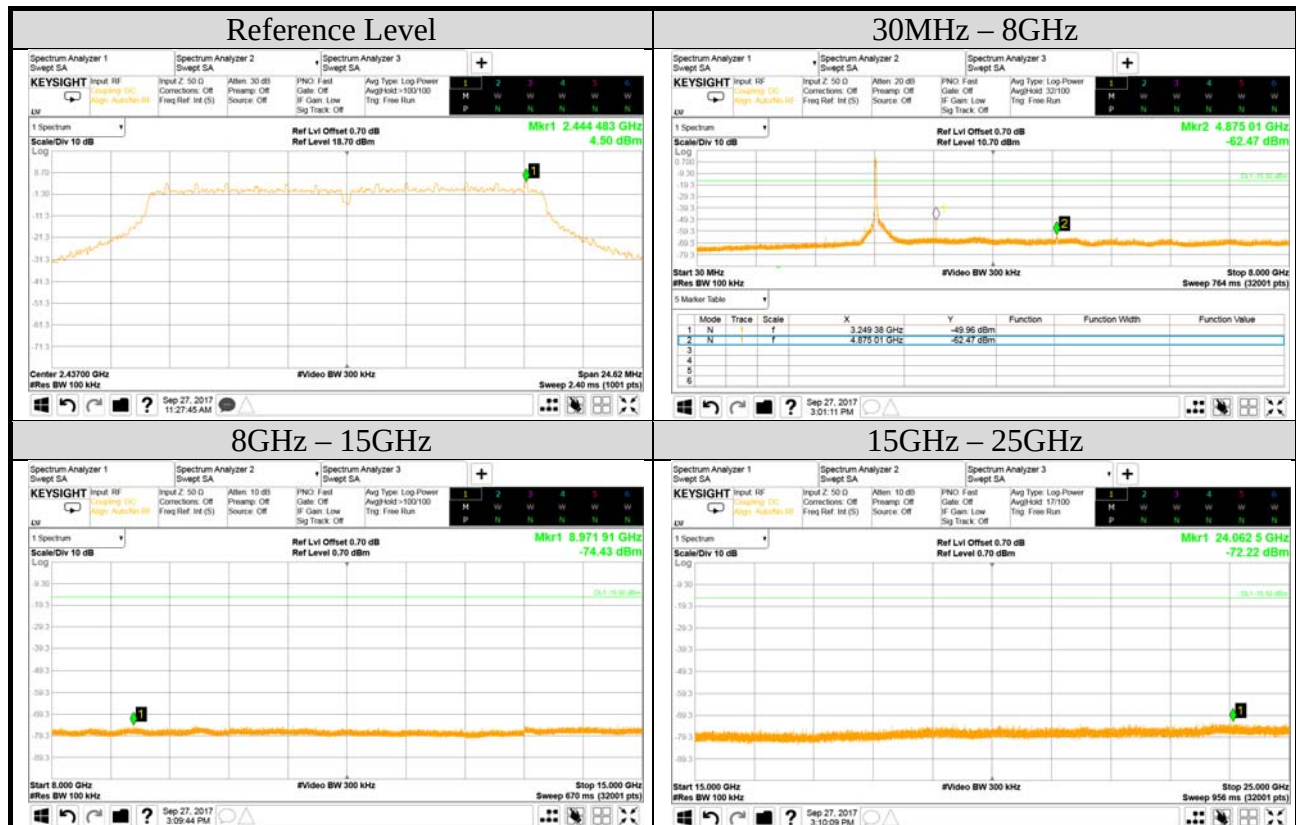

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303


Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11g	Frequency	TX 2462MHz
Simultaneous Factor10 log(n) (Note: "n" is antenna number)	0		

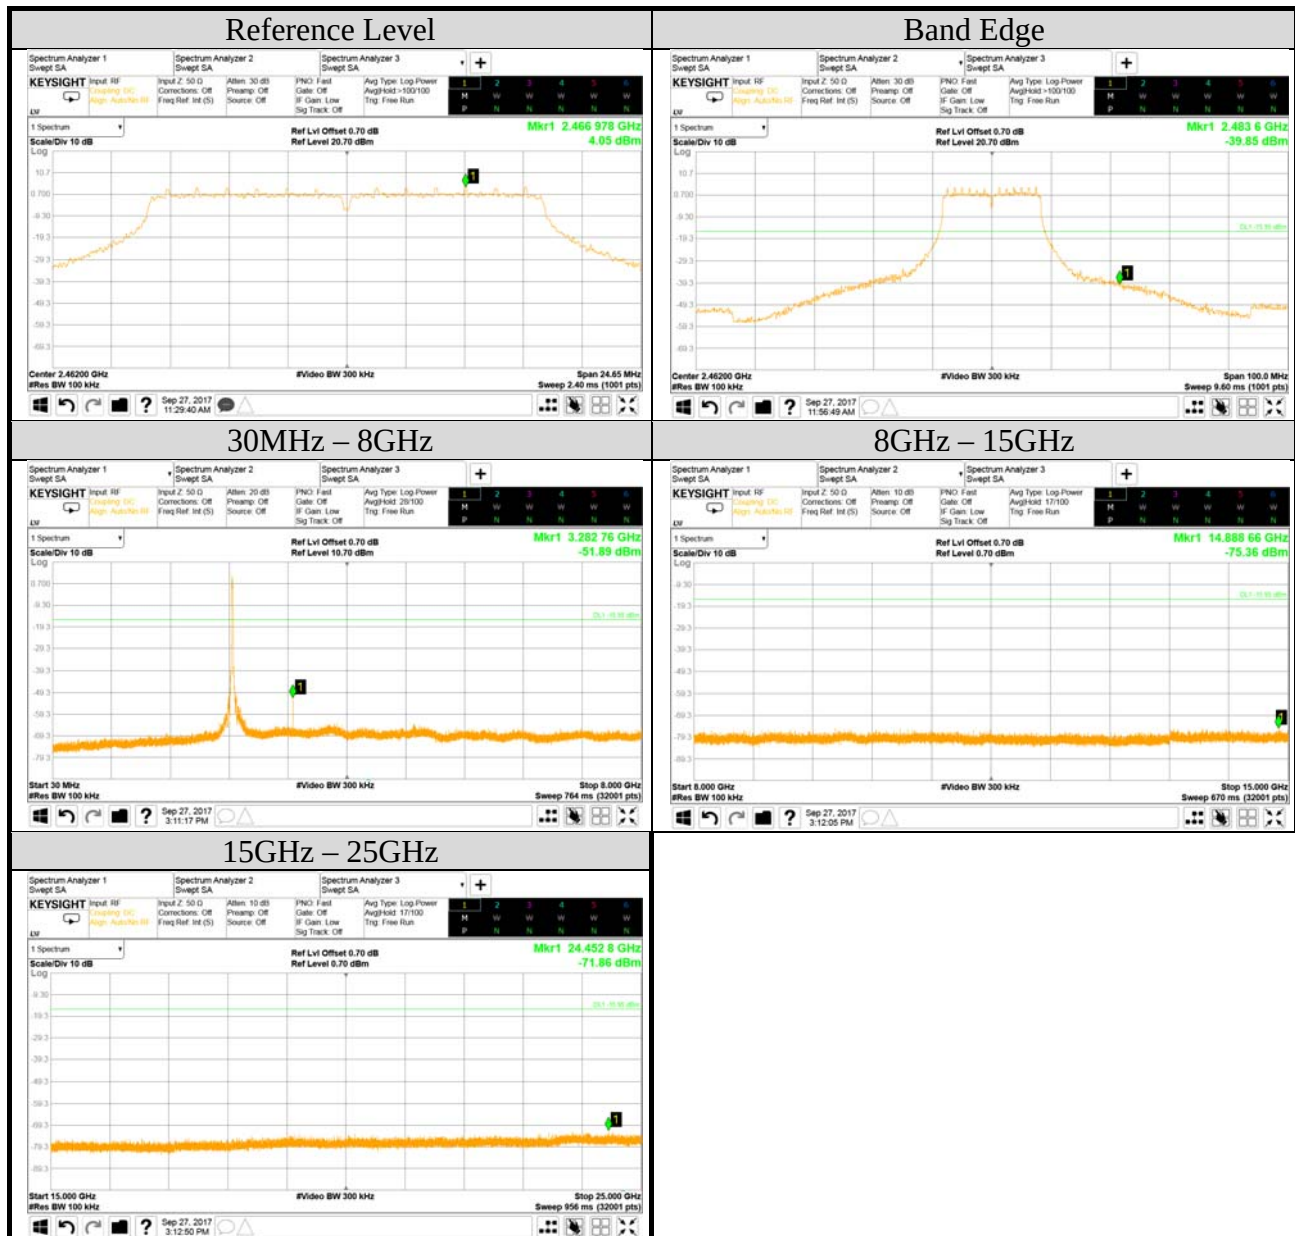

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11n-HT20	Frequency	TX 2412MHz
Simultaneous Factor10 log(n) (Note: "n" is antenna number)		0	

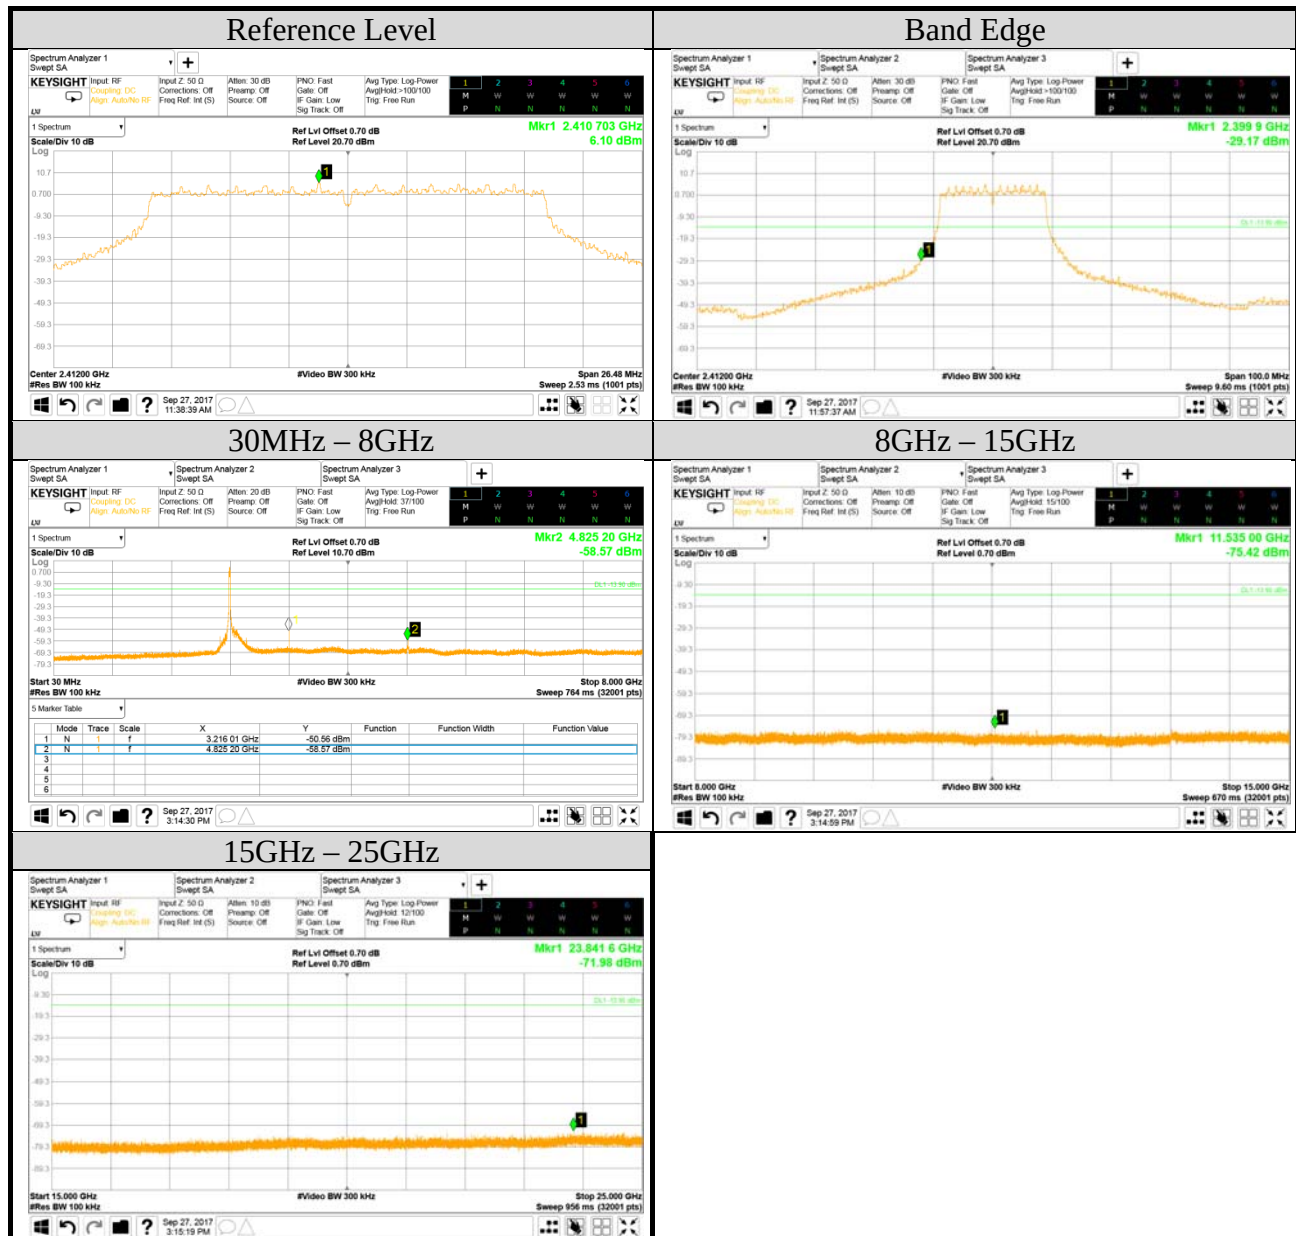

Audix Technology Corp.


No. 53-11, Dingfu, Linkou, Dist.,

New Taipei City244, Taiwan

Tel: +886 2 26099301

Fax: +886 2 26099303

Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11n-HT20	Frequency	TX 2437MHz
Simultaneous Factor10 log(n) (Note: “n” is antenna number)			0

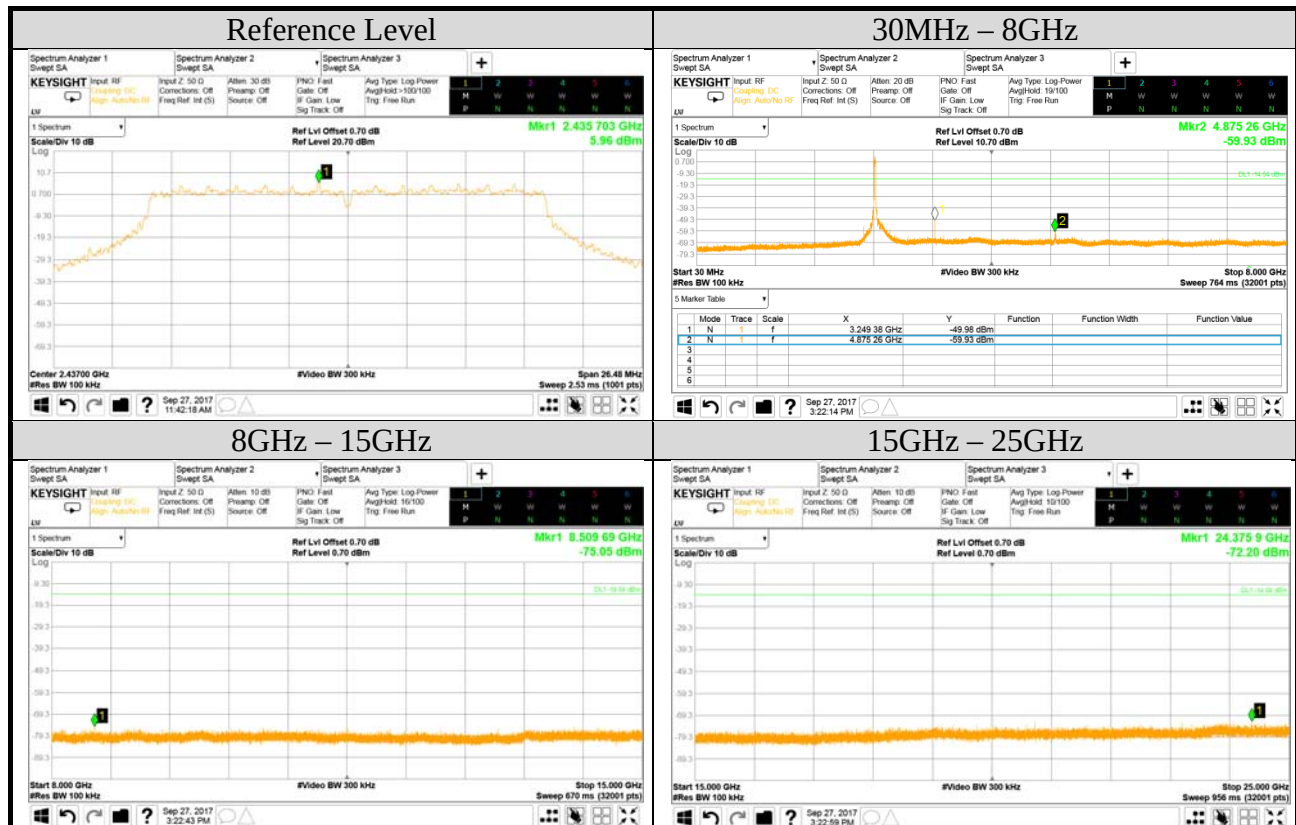

File Number: C1M1707267

Report Number: EM-F170641

This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.

Audix Technology Corp.


No. 53-11, Dingfu, Linkou, Dist.,

New Taipei City244, Taiwan

Tel: +886 2 26099301

Fax: +886 2 26099303

Test Date	2017/09/27	Temp./Hum.	23°C/55%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Mode	802.11n-HT20	Frequency	TX 2462MHz
Simultaneous Factor	10 log(n) (Note: "n" is antenna number)		0

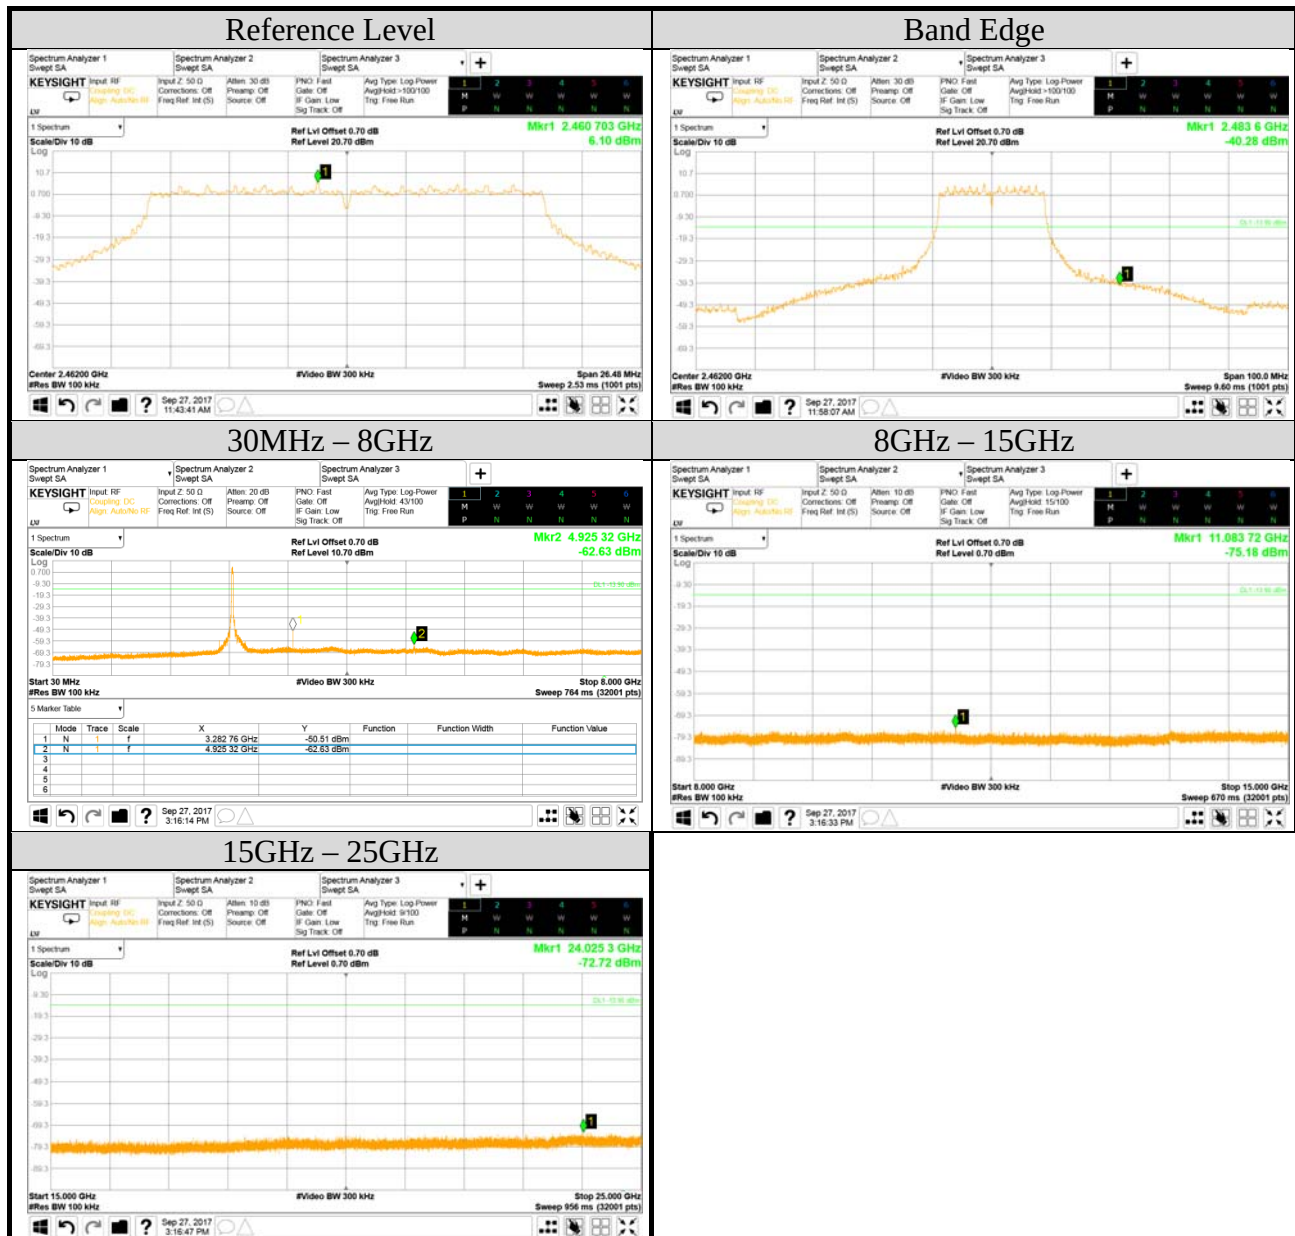

A.6 POWER SPECTRAL DENSITY

Test Date	2017/10/06~26	Temp./Hum.	23~24°C/55~56%
Cable Loss	0.7dB	Test Voltage	DC 3.3V (through jig via Notebook PC)
Simultaneous Factor 10 log(n) (Note: "n" is antenna number)			3 for PCB Antenna, 0 for Omni-S Antenna

A.6.1 Power Spectral Density Result

Mode	Centre Frequency (MHz)	Power Spectral Density (dBm)	Limit
BLE	2402	5.69	< 8 dBm/3kHz
	2440	6.18	
	2480	6.18	

● Antenna: Omni-S Antenna

Mode	Centre Frequency (MHz)	Power Spectral Density (dBm)	Limit
802.11b	2412	-6.01	< 8 dBm/3kHz
	2437	-4.93	
	2462	-6.07	
802.11g	2412	-11.84	
	2437	-8.17	
	2462	-14.14	
802.11n-HT20	2412	-13.39	
	2437	-8.25	
	2462	-14.28	

● Antenna: PCB Antenna


Mode	Centre Frequency (MHz)	Omni-S Antenna Power Spectral Density (dBm)	Simultaneous Factor for PCB antenna	PCB Antenna Power Spectral Density (dBm)	Limit
802.11b	2412	-6.01	3	-3.01	< 8 dBm/3kHz
	2437	-4.93	3	-1.93	
	2462	-6.07	3	-3.07	
802.11g	2412	-11.84	3	-8.84	
	2437	-8.17	3	-5.17	
	2462	-14.14	3	-11.14	
802.11n-HT20	2412	-13.39	3	-10.39	
	2437	-8.25	3	-5.25	
	2462	-14.28	3	-11.28	

Note: All results have been included cable loss and Simultaneous Factor.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

A.6.2 Measurement Plots

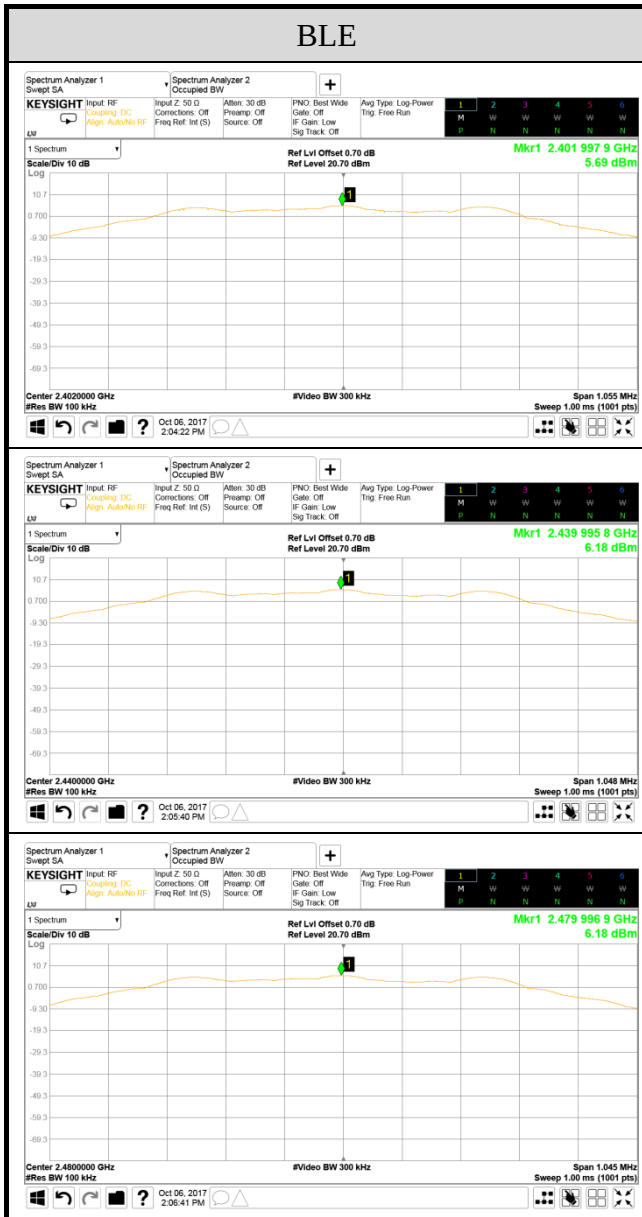

Note: All results have been included cable loss and Simultaneous Factor.


Audix Technology Corp.

No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301

Fax: +886 2 26099303


● Antenna: Omni-S Antenna

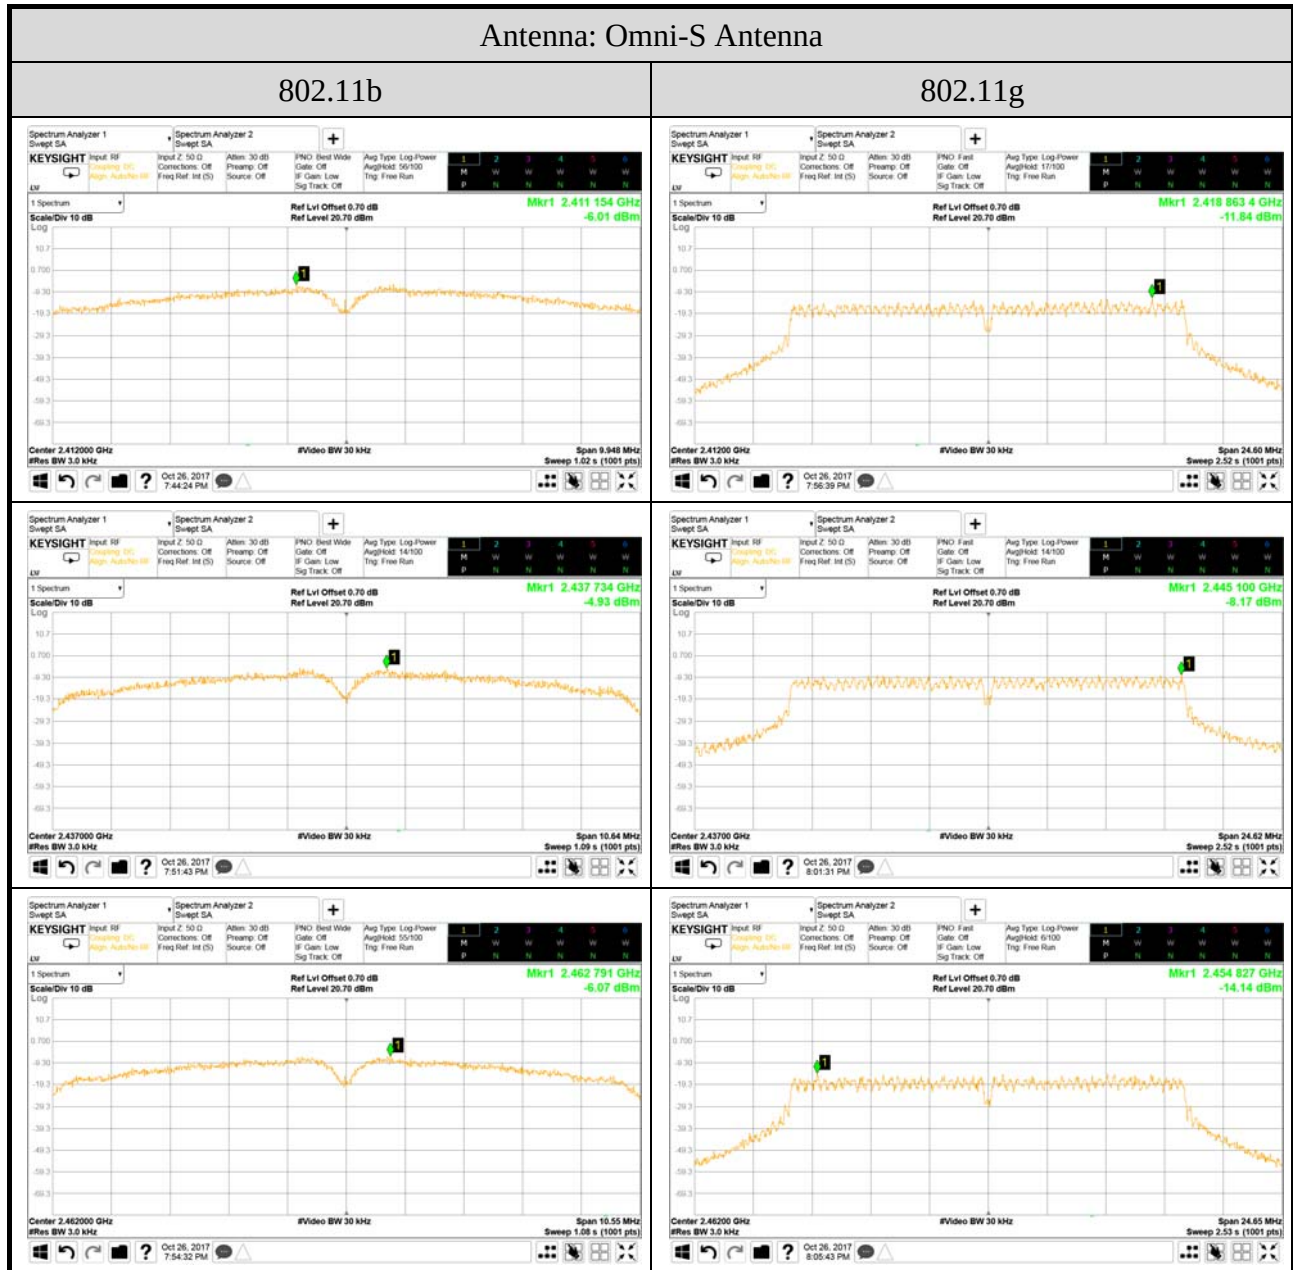

Note: All results have been included cable loss and Simultaneous Factor.

Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City244, Taiwan

Tel: +886 2 26099301
Fax: +886 2 26099303

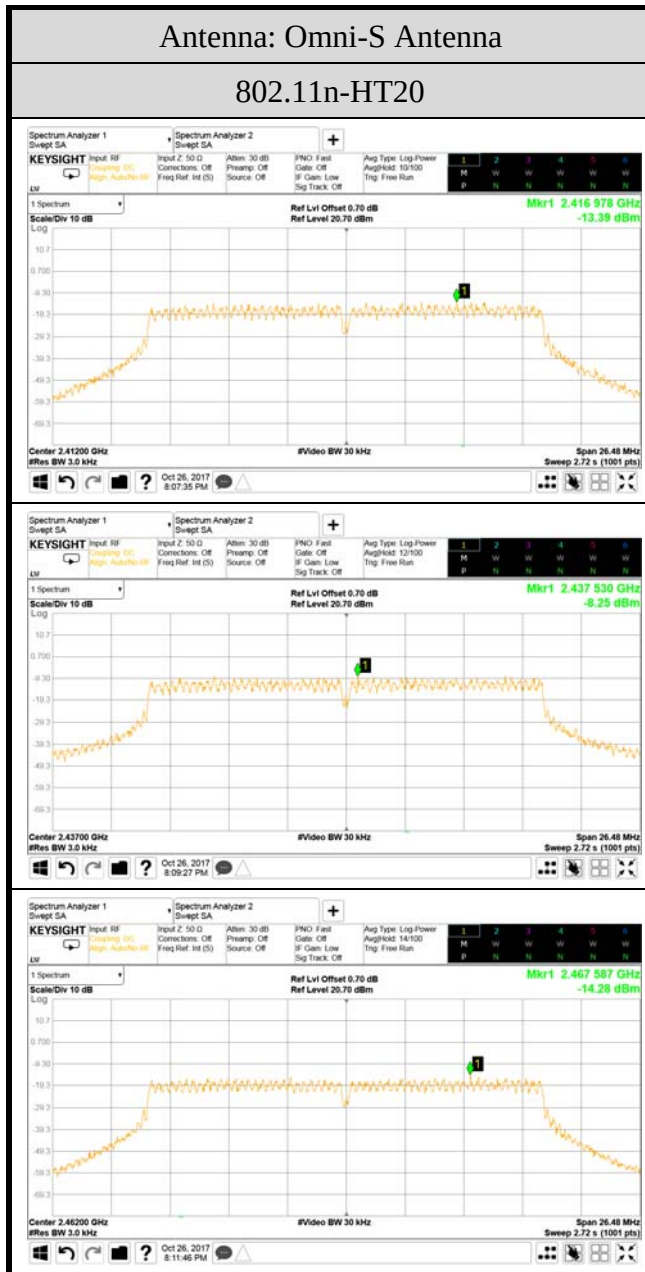

Note: All results have been included cable loss and Simultaneous Factor.



Audix Technology Corp.
No. 53-11, Dingfu, Linkou, Dist.,
New Taipei City 244, Taiwan

APPENDIX B

Tel: +886 2 26099301
Fax: +886 2 26099303

APPENDIX B

TEST PHOTOGRAPHS

(Model: M2SD50NBT)