








PSD NVNT be20 5240MHz Ant4

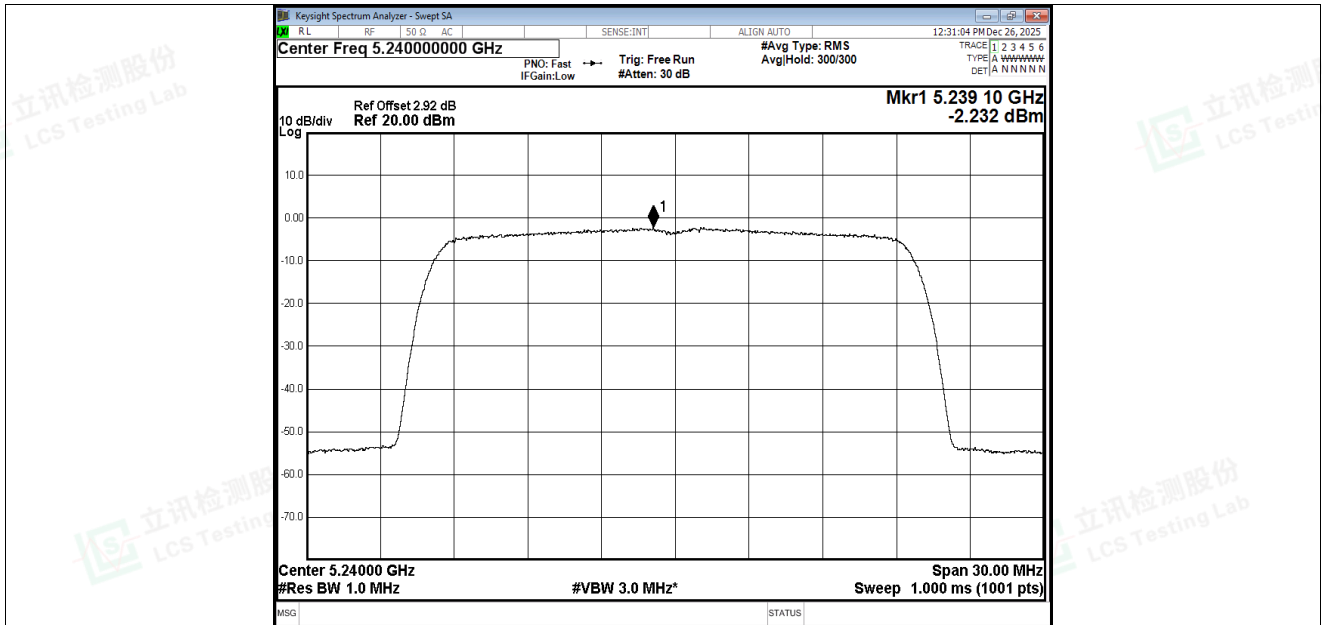


PSD NVNT be40 5190MHz Ant4

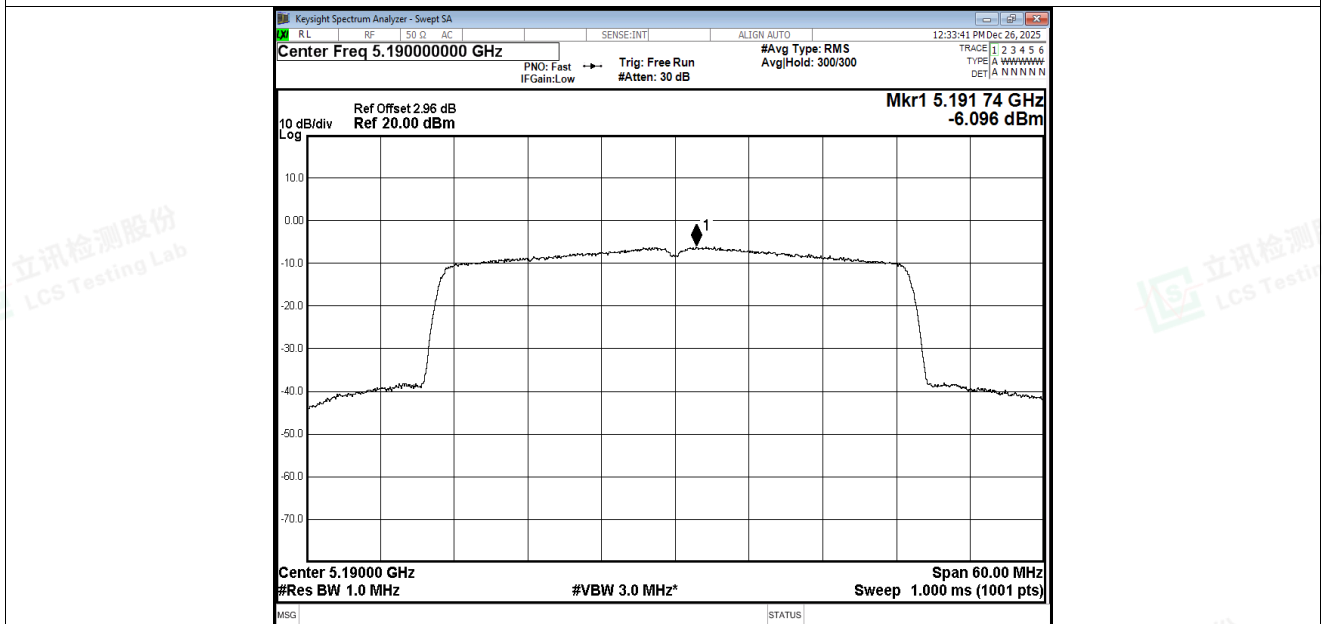


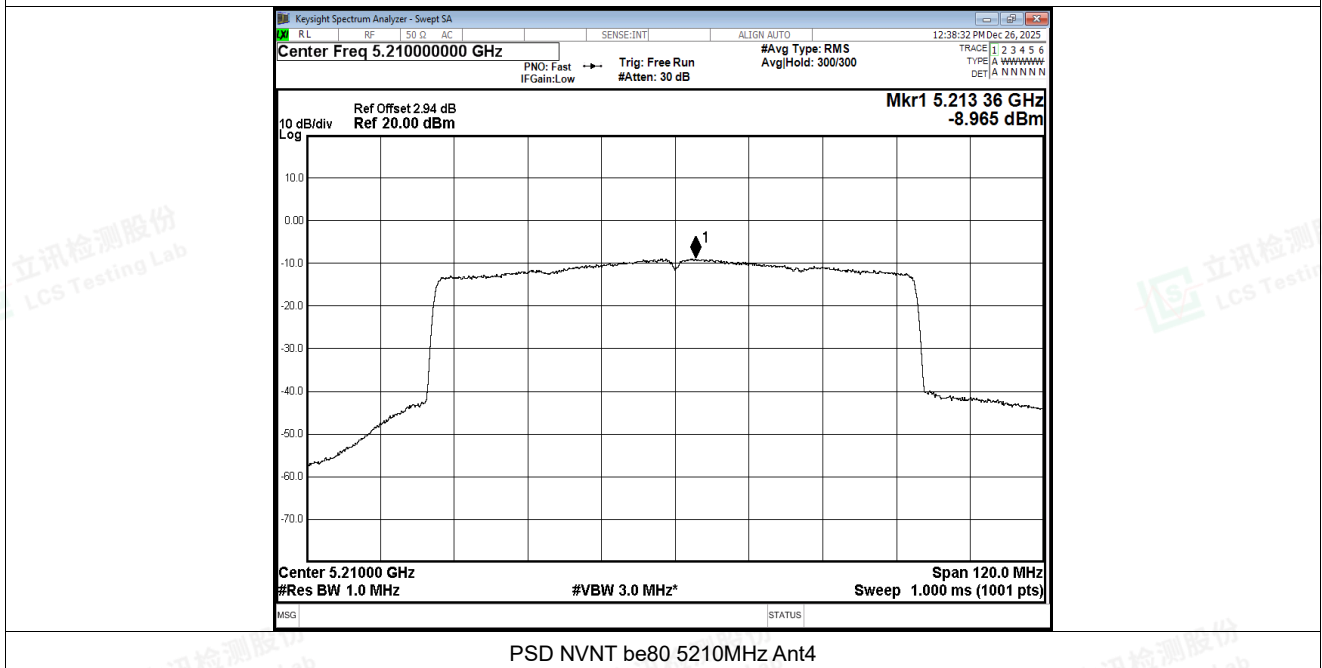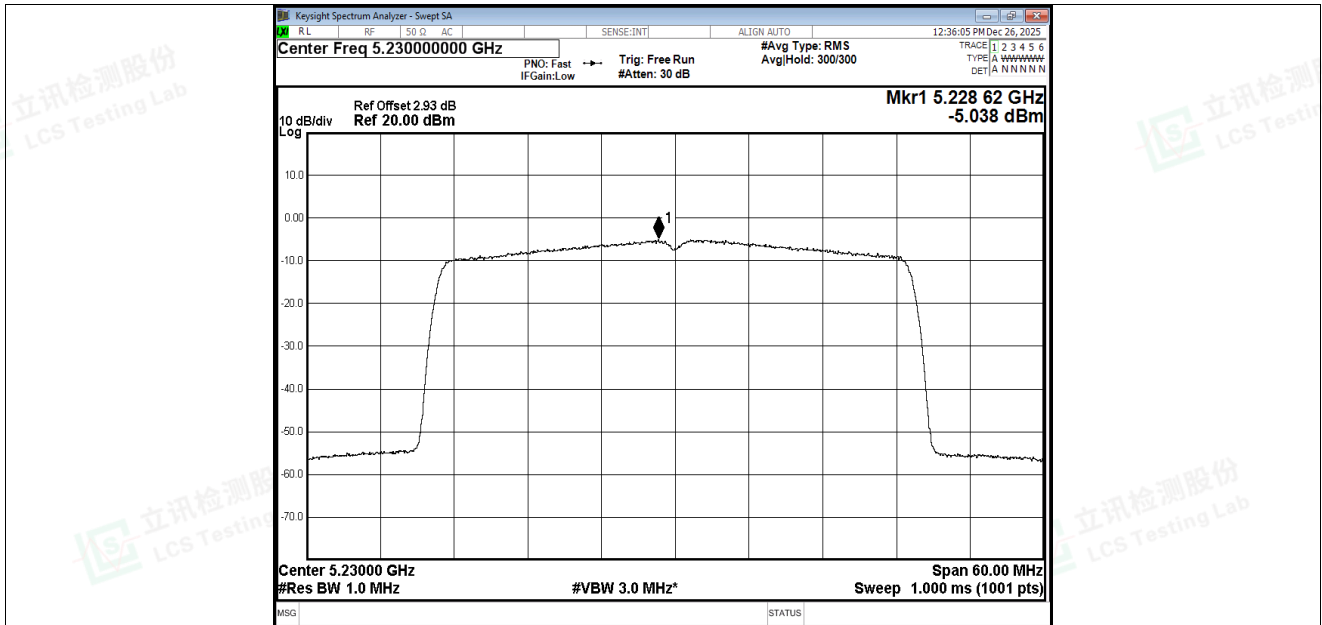

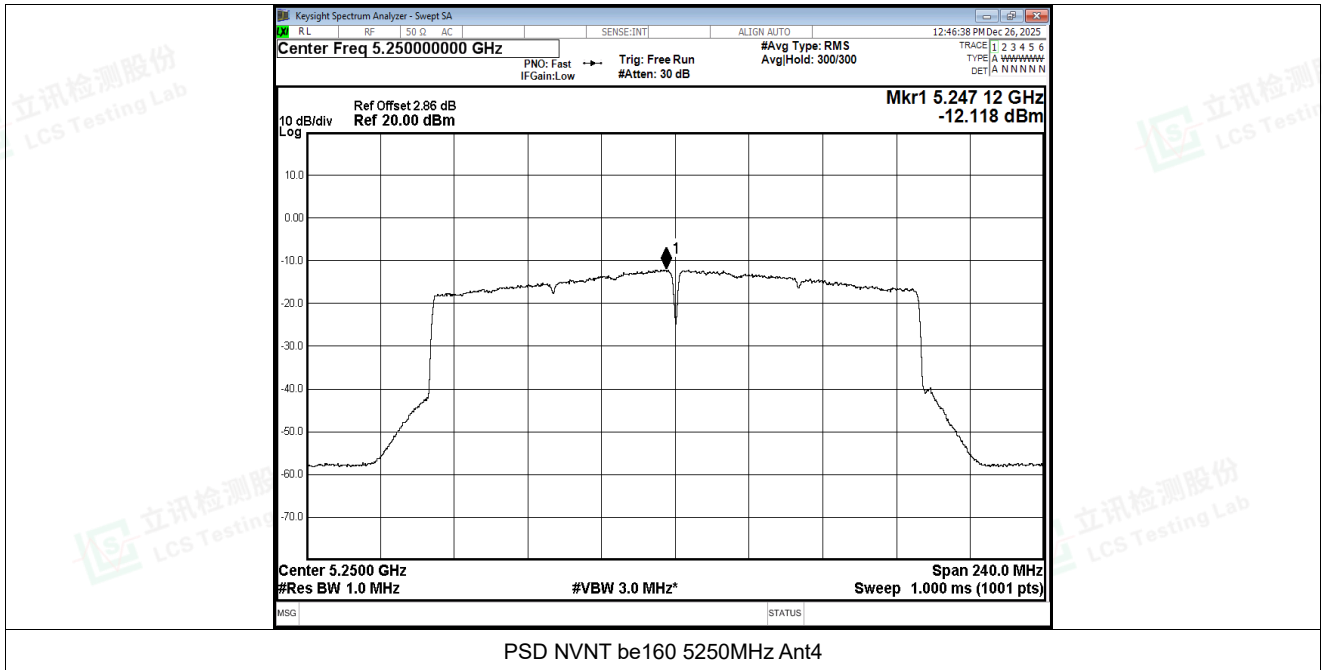

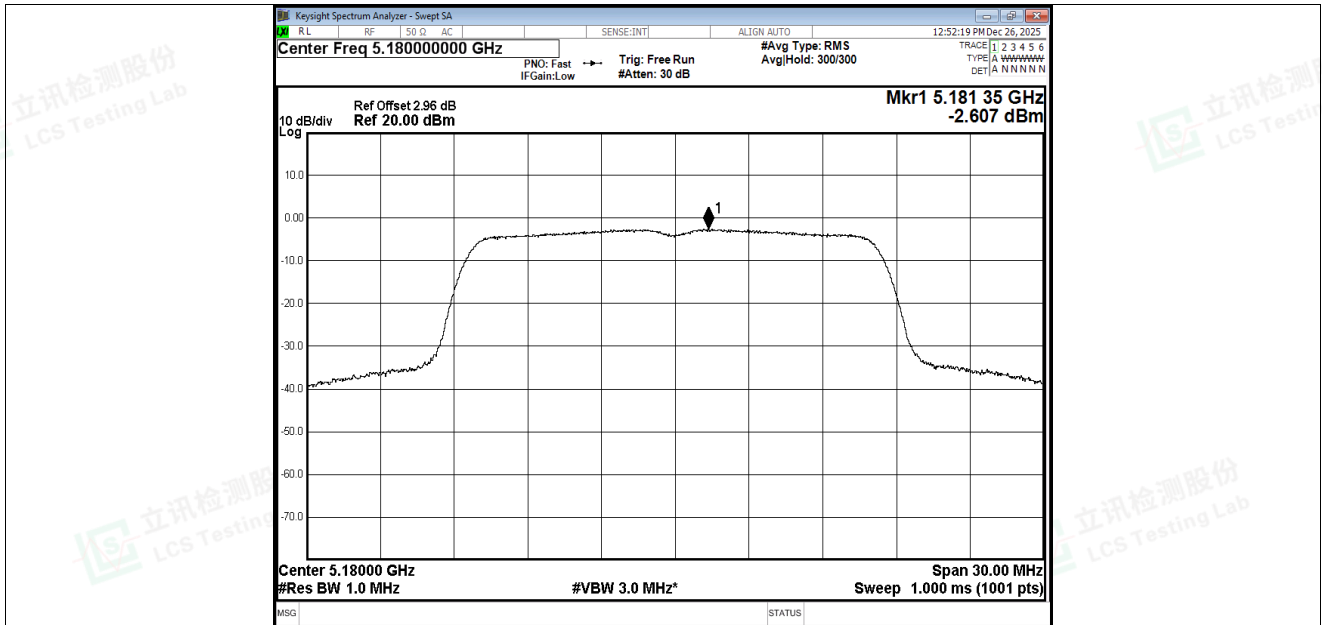


PSD NVNT a 5180MHz Ant5

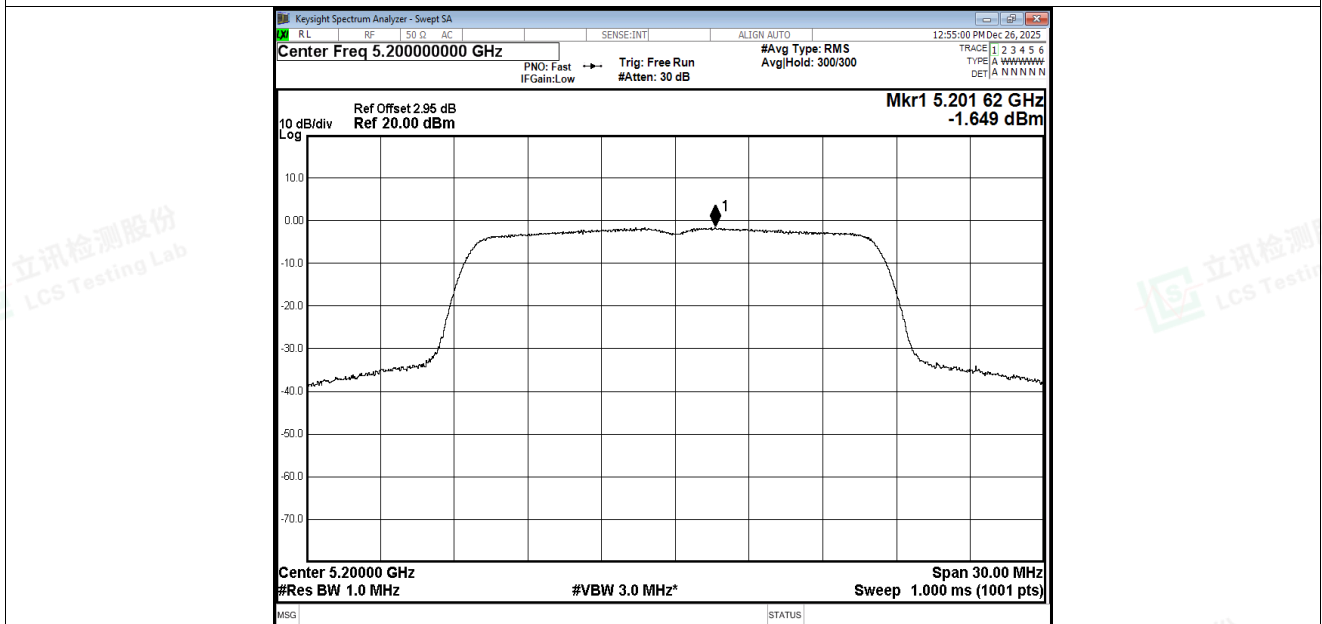


PSD NVNT a 5200MHz Ant5



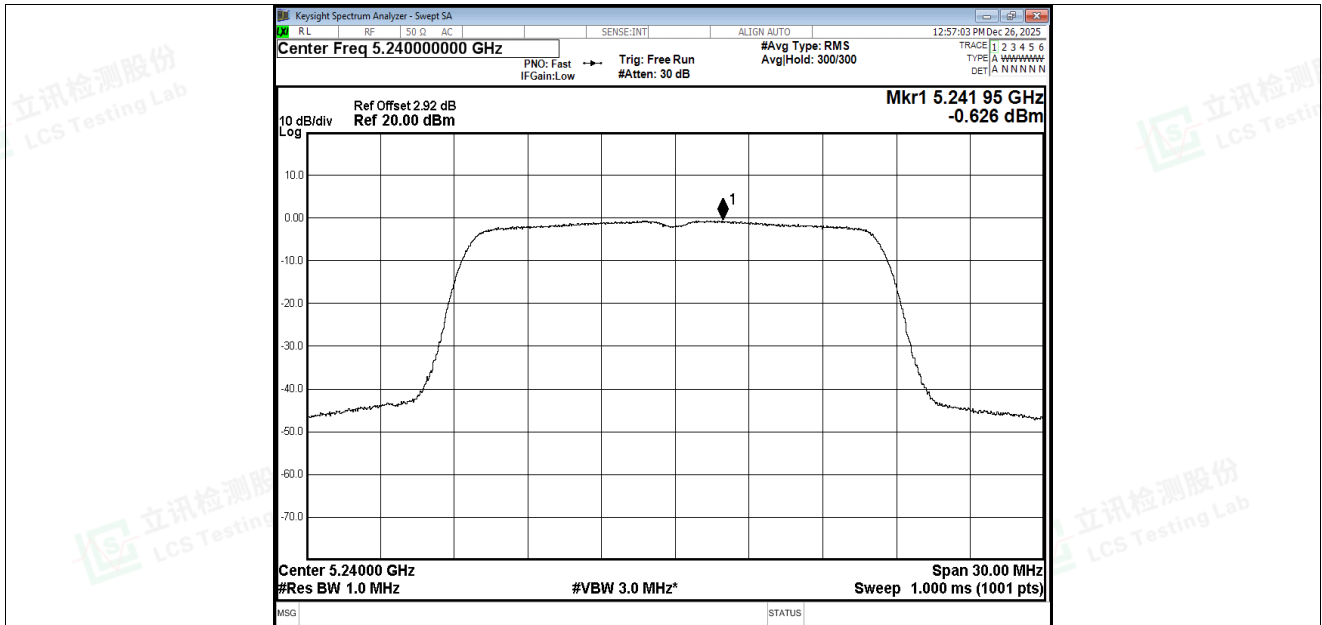


PSD NVNT a 5240MHz Ant5

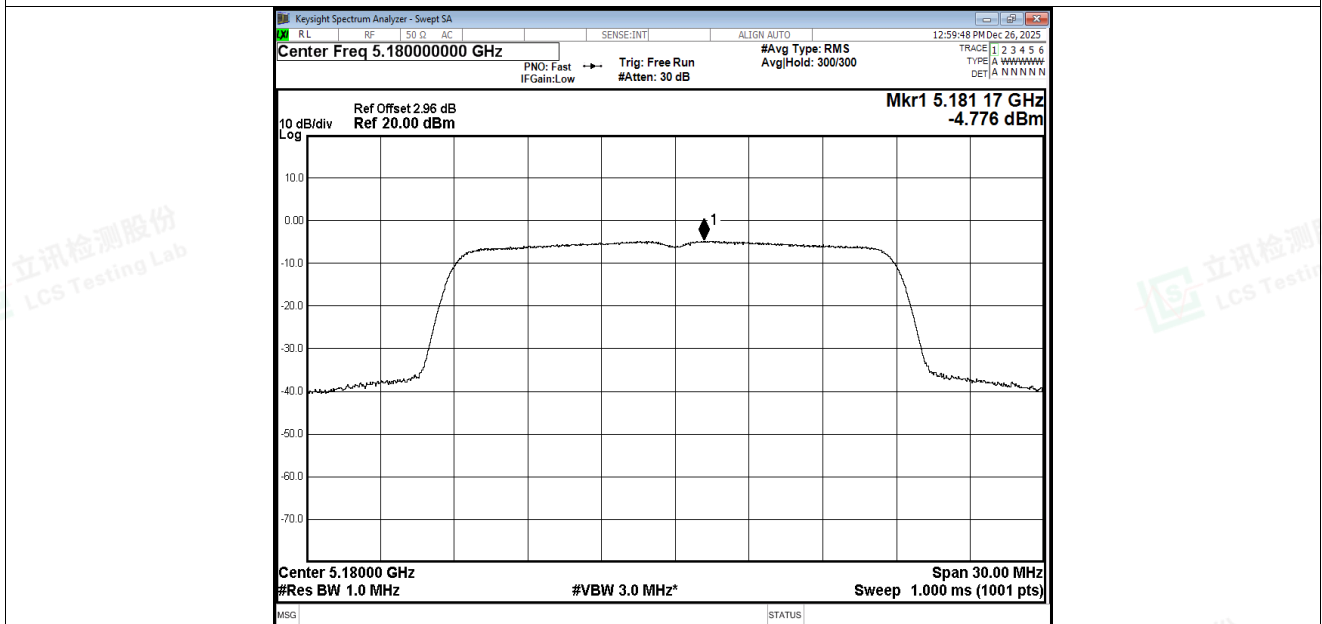


PSD NVNT n20 5180MHz Ant5




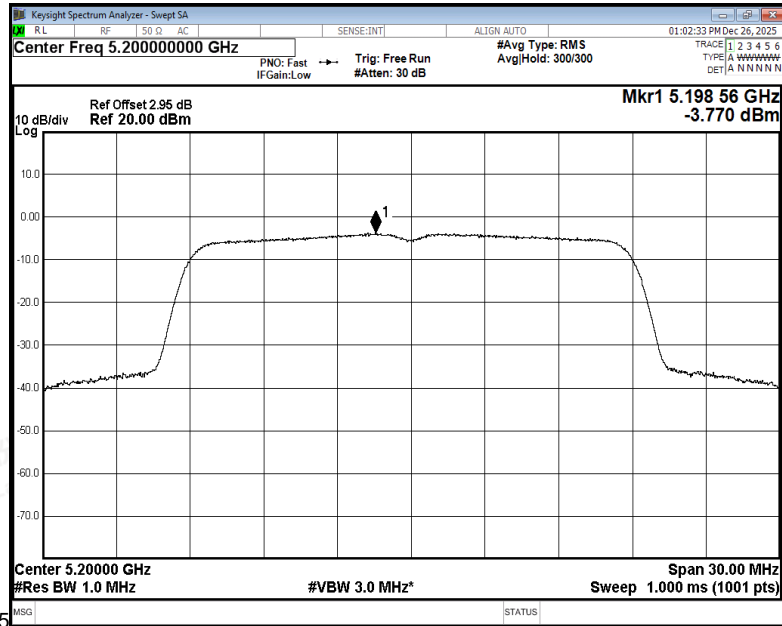




PSD NVNT n20 5200MHz Ant5


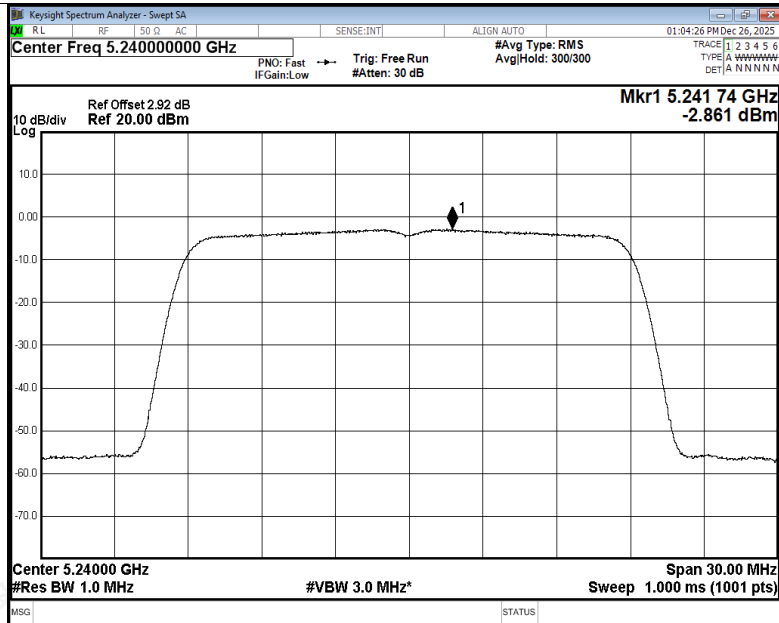




PSD NVNT n20 5240MHz Ant5




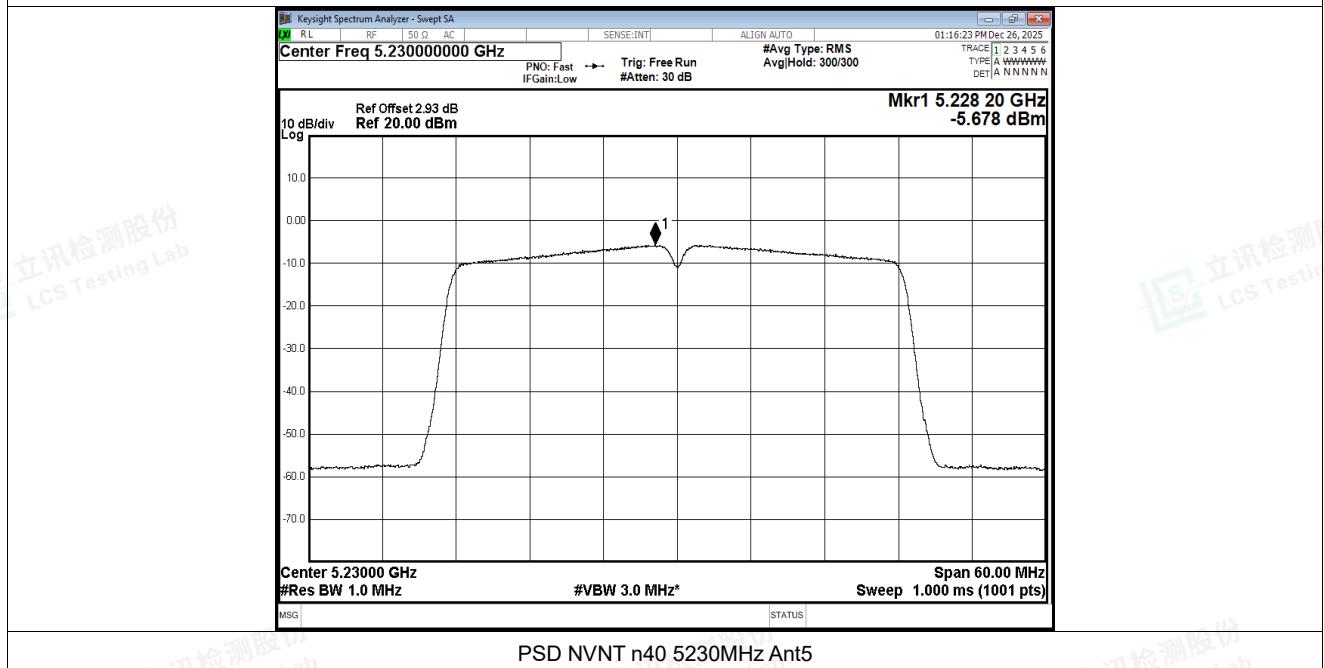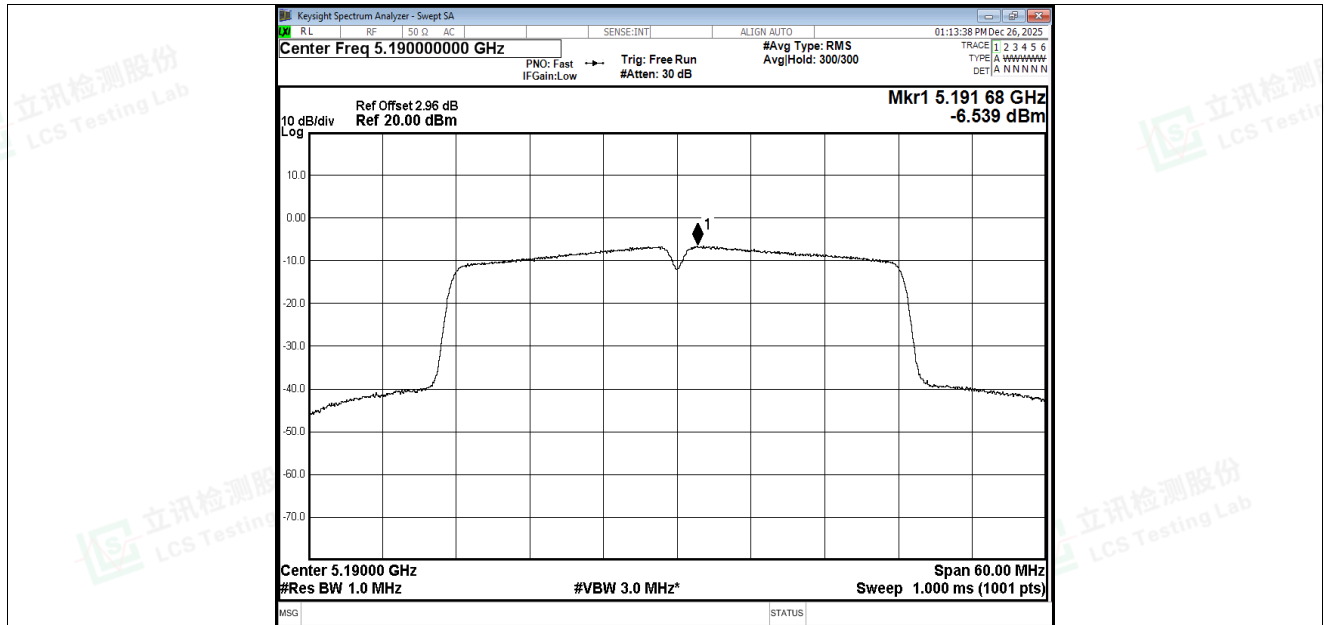

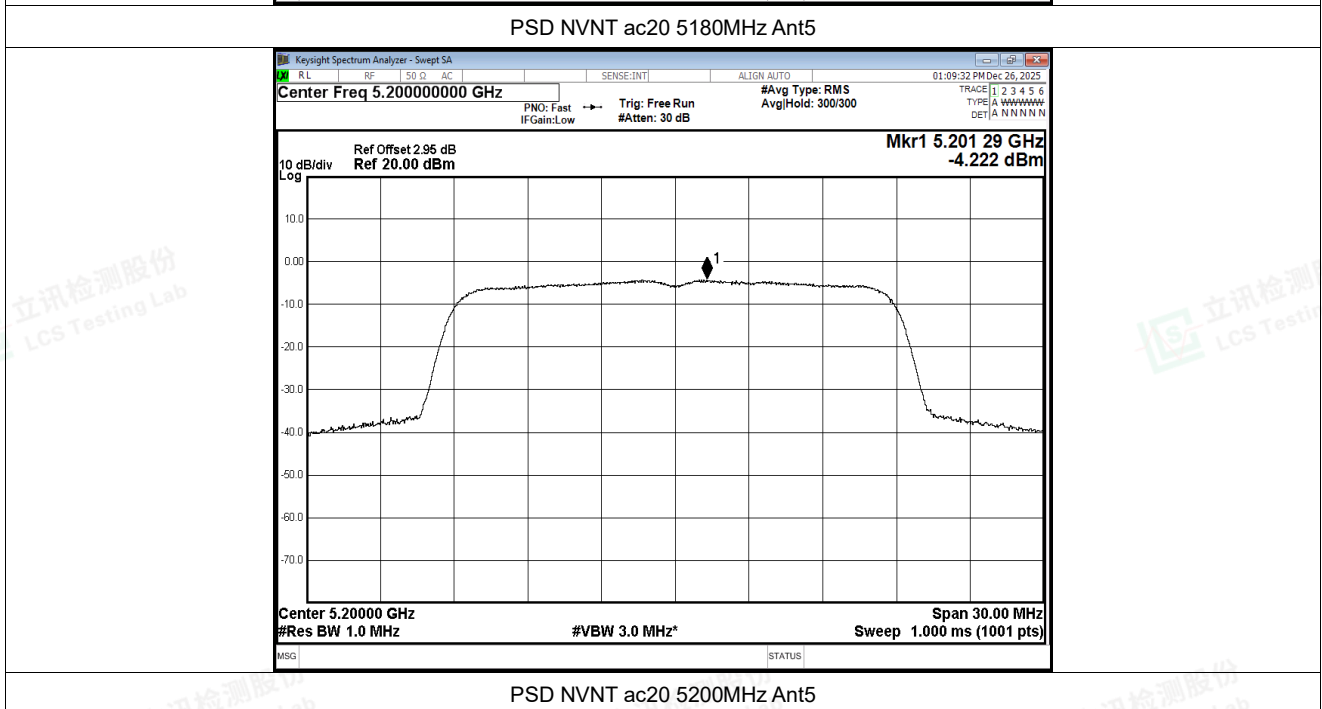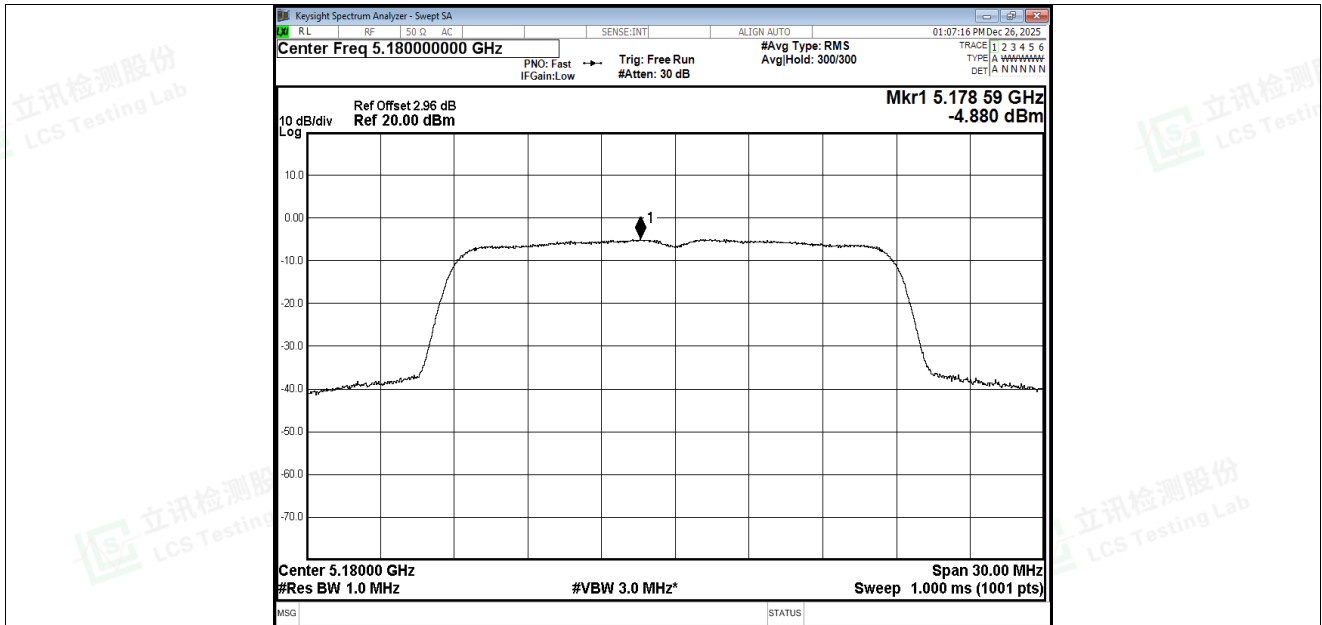


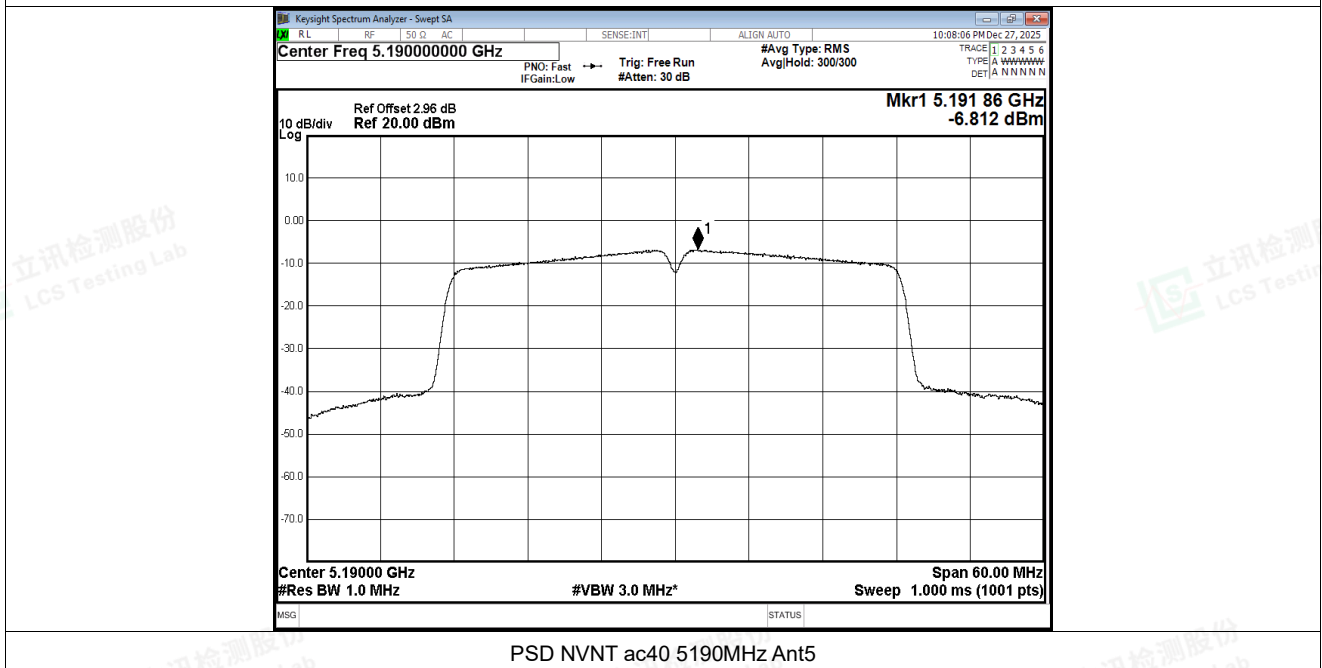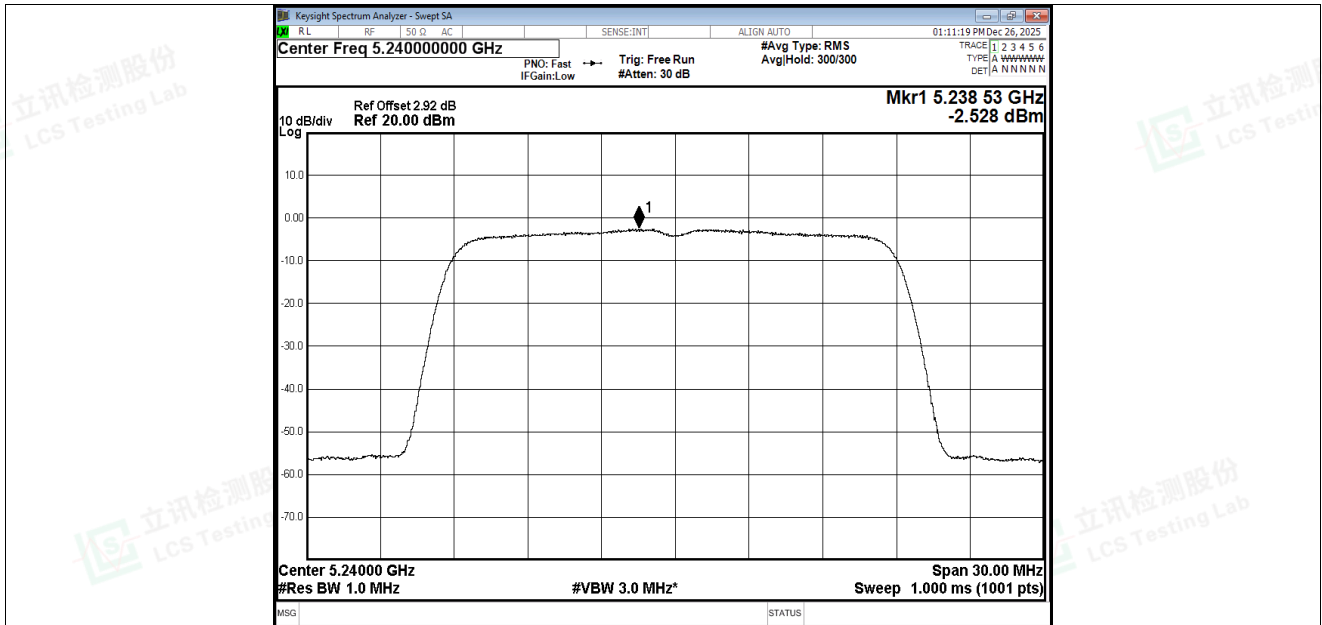

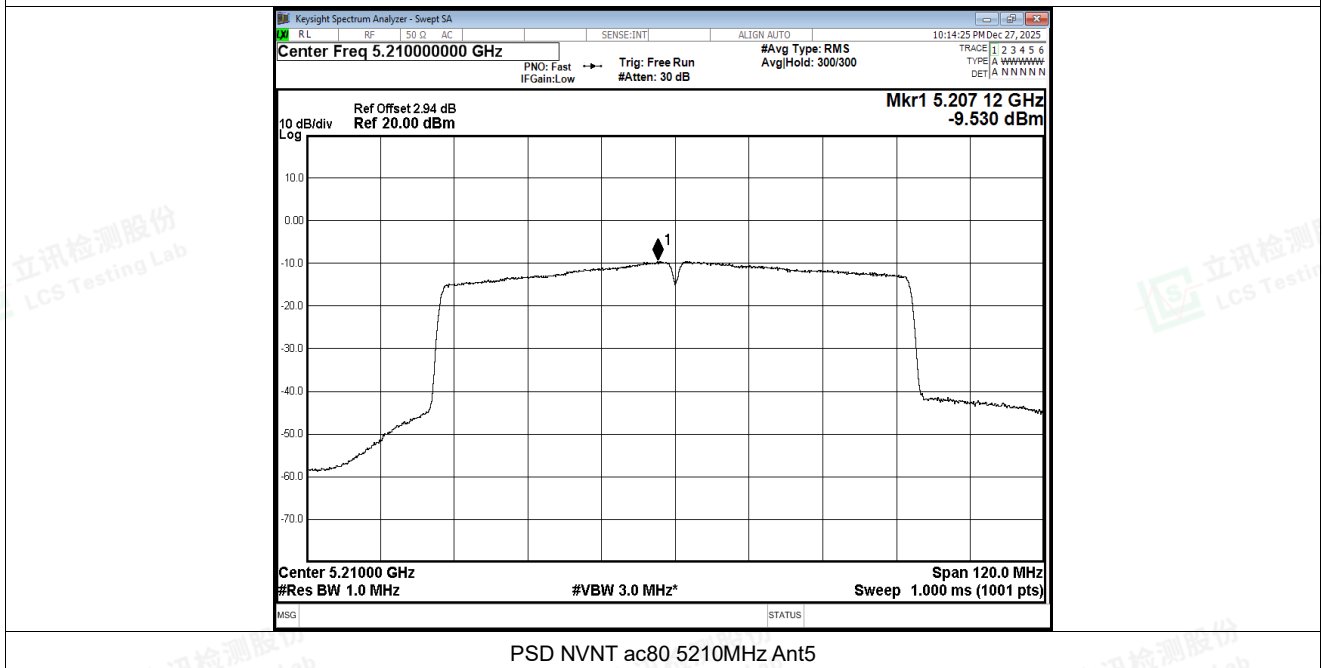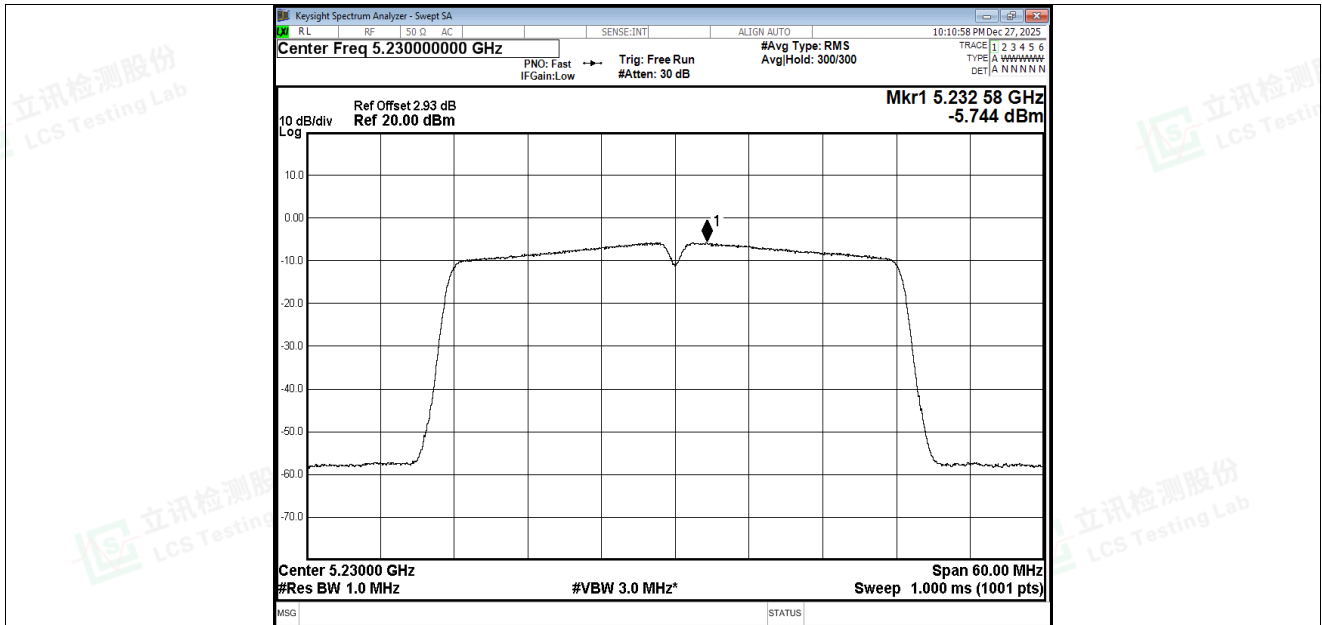

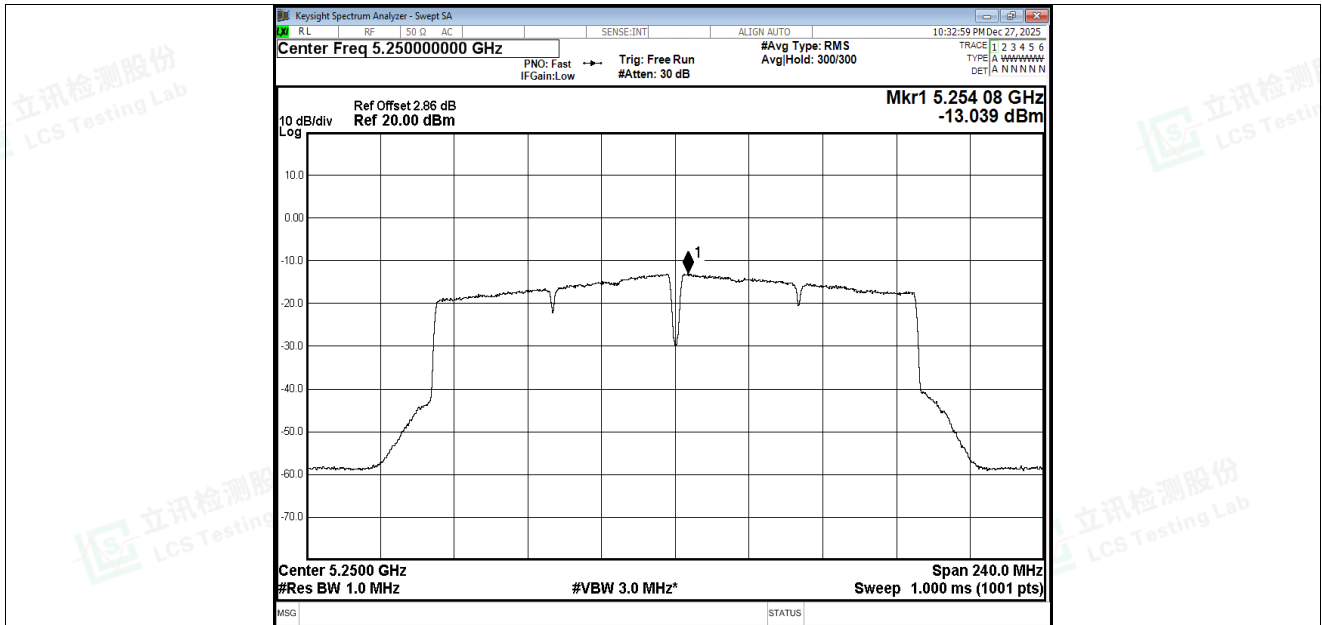

PSD NVNT ac160 5250MHz Ant5

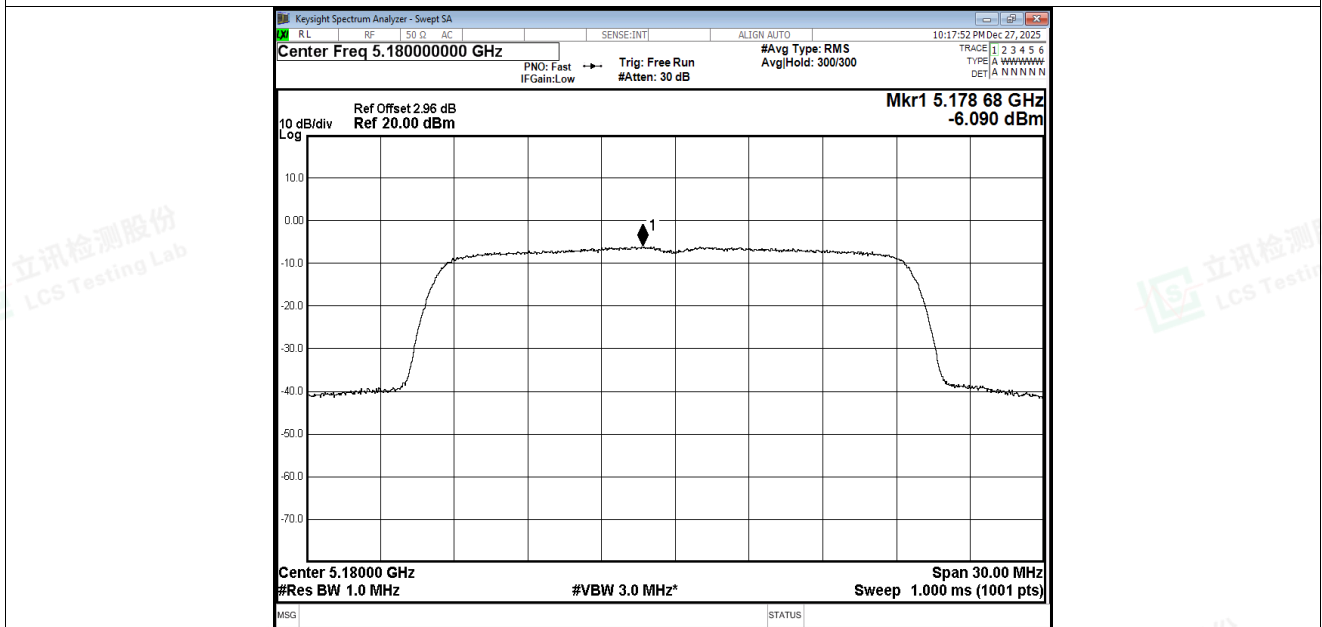

PSD NVNT ax20 5180MHz Ant5




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity


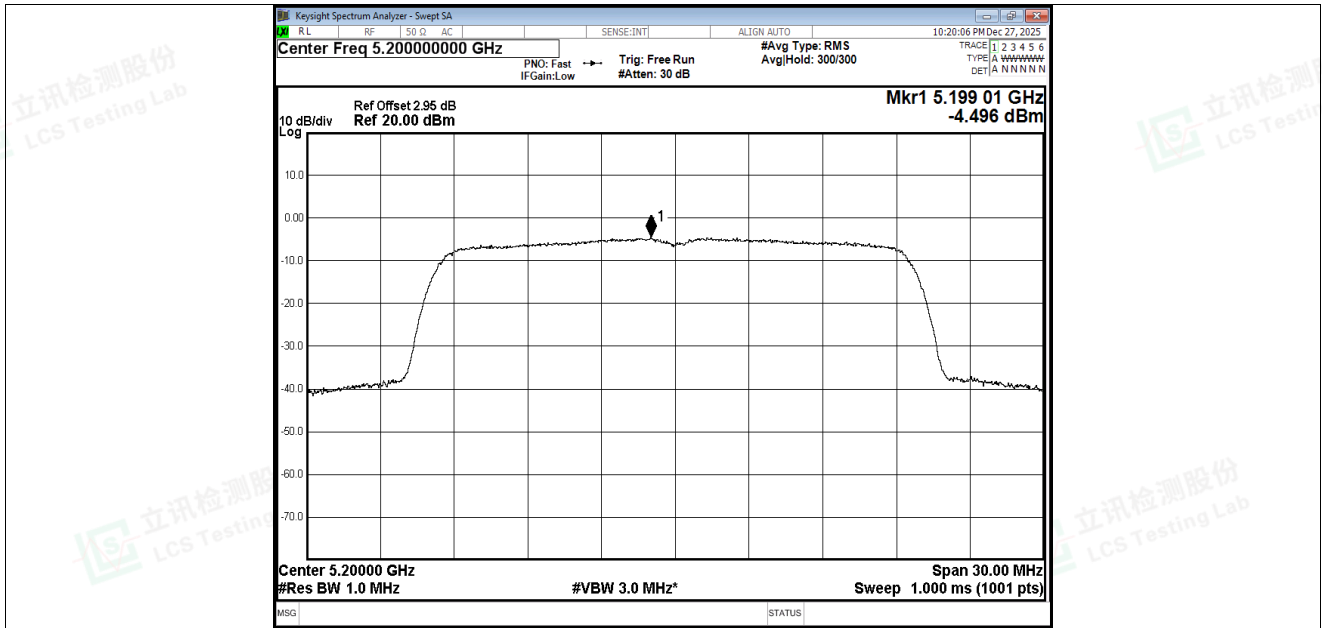




PSD NVNT ax20 5200MHz Ant5

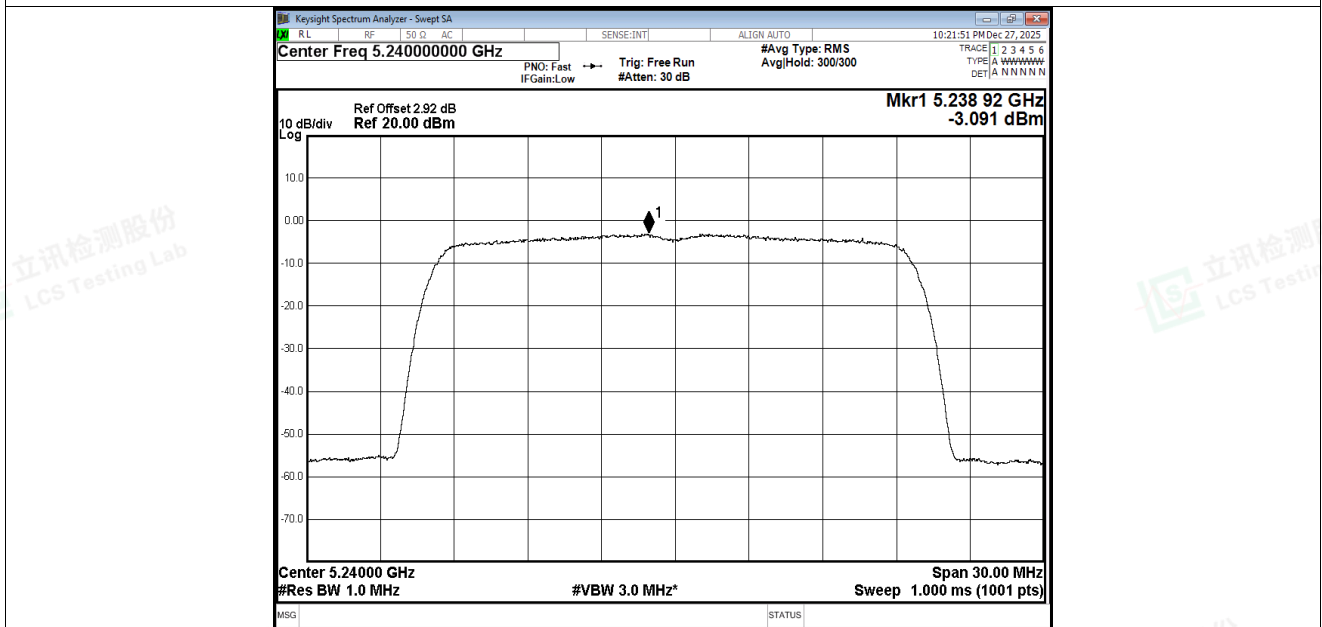


PSD NVNT ax20 5240MHz Ant5




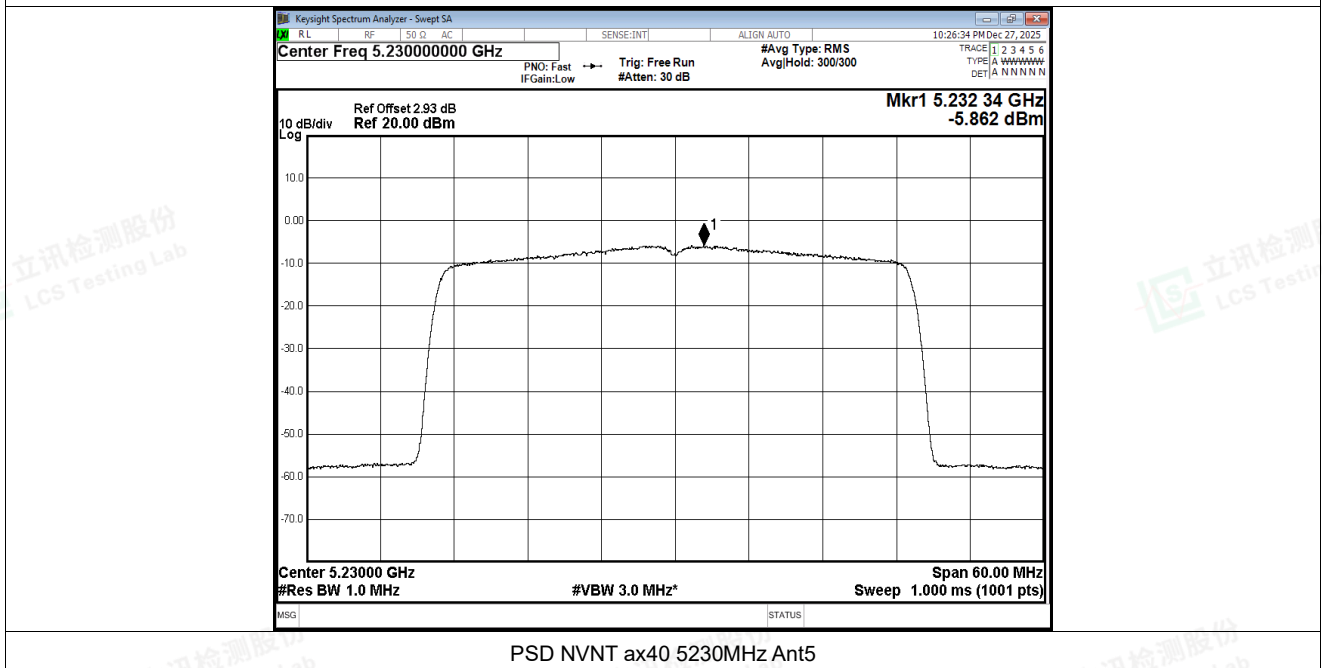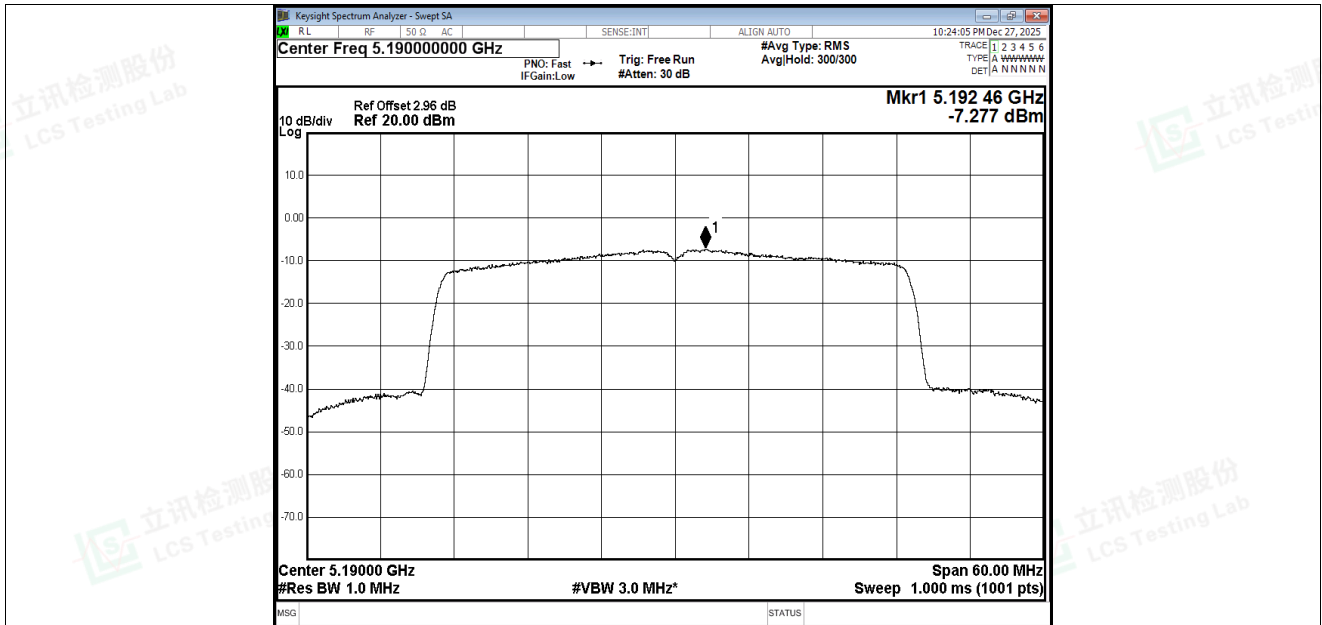

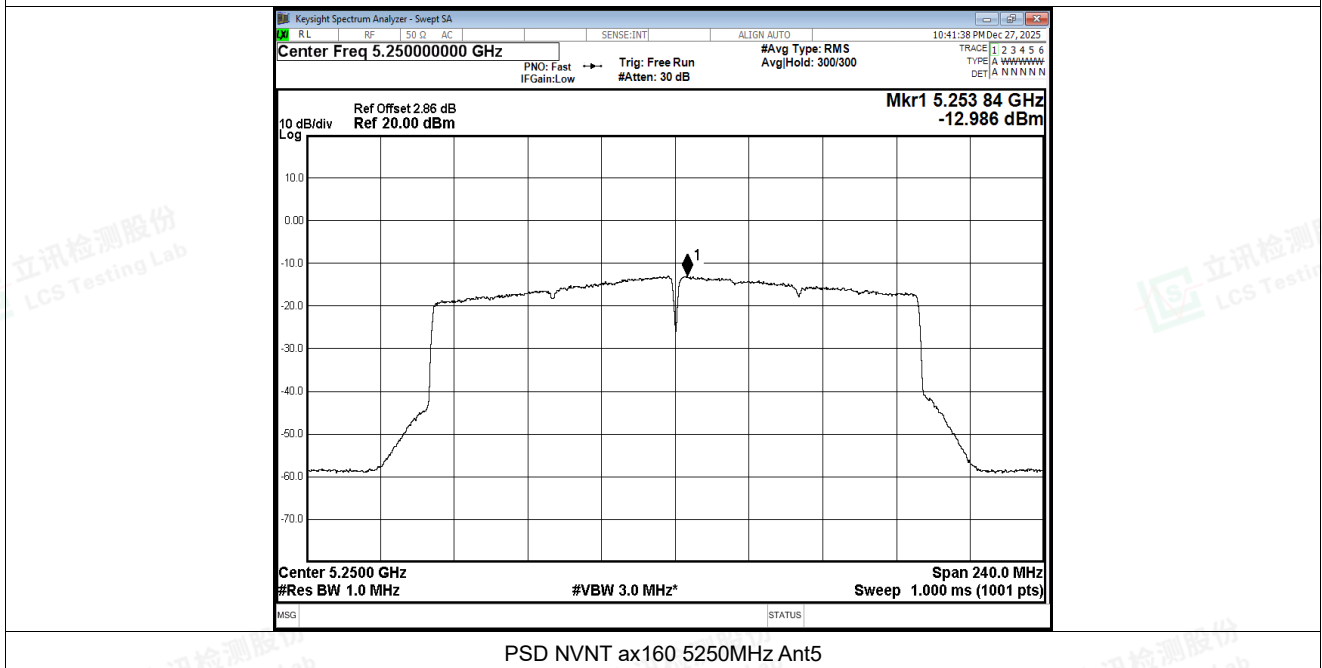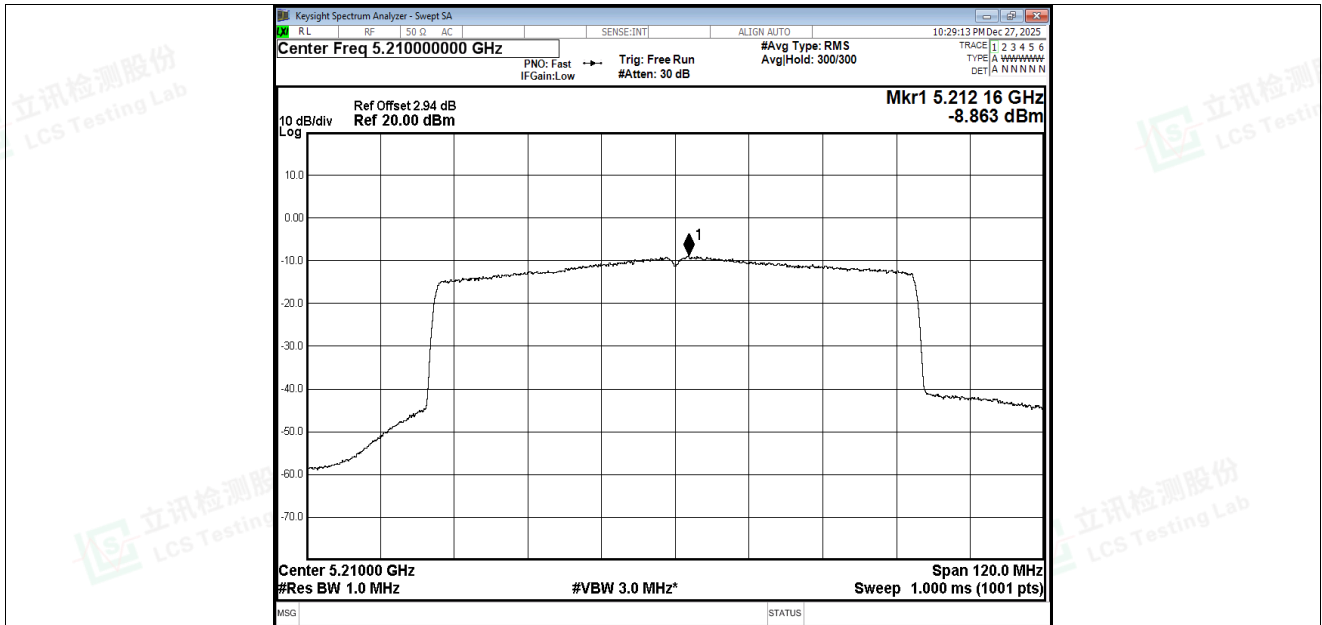


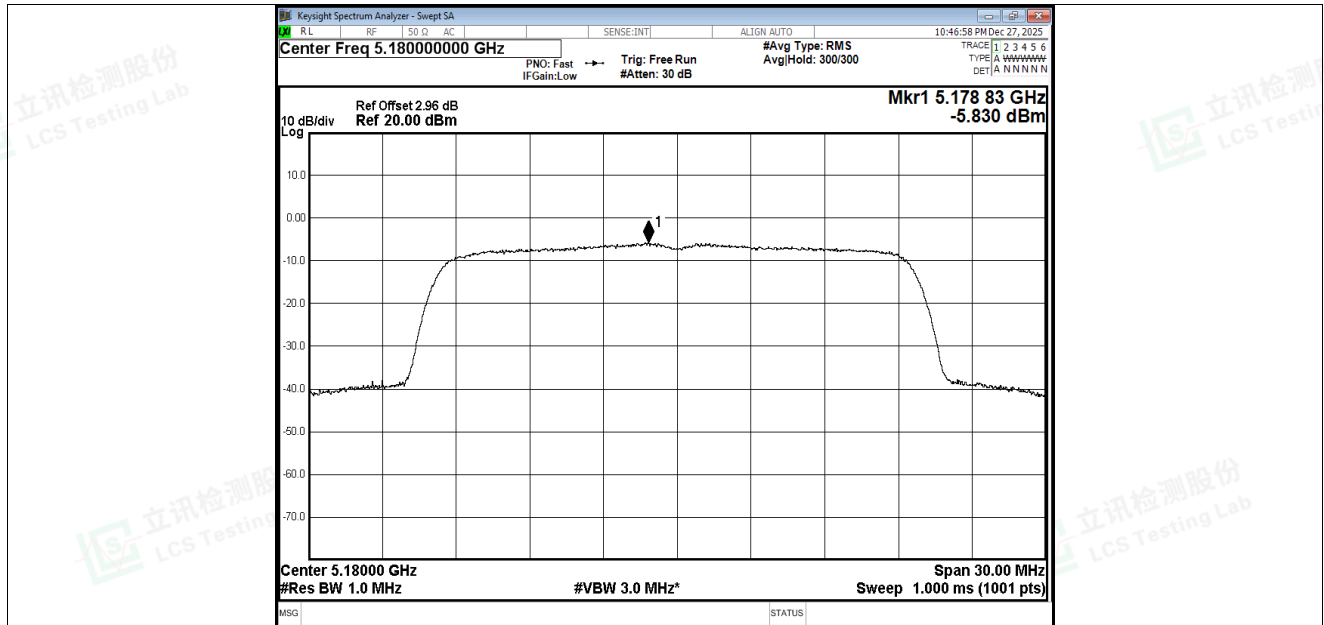



PSD NVNT be20 5180MHz Ant5

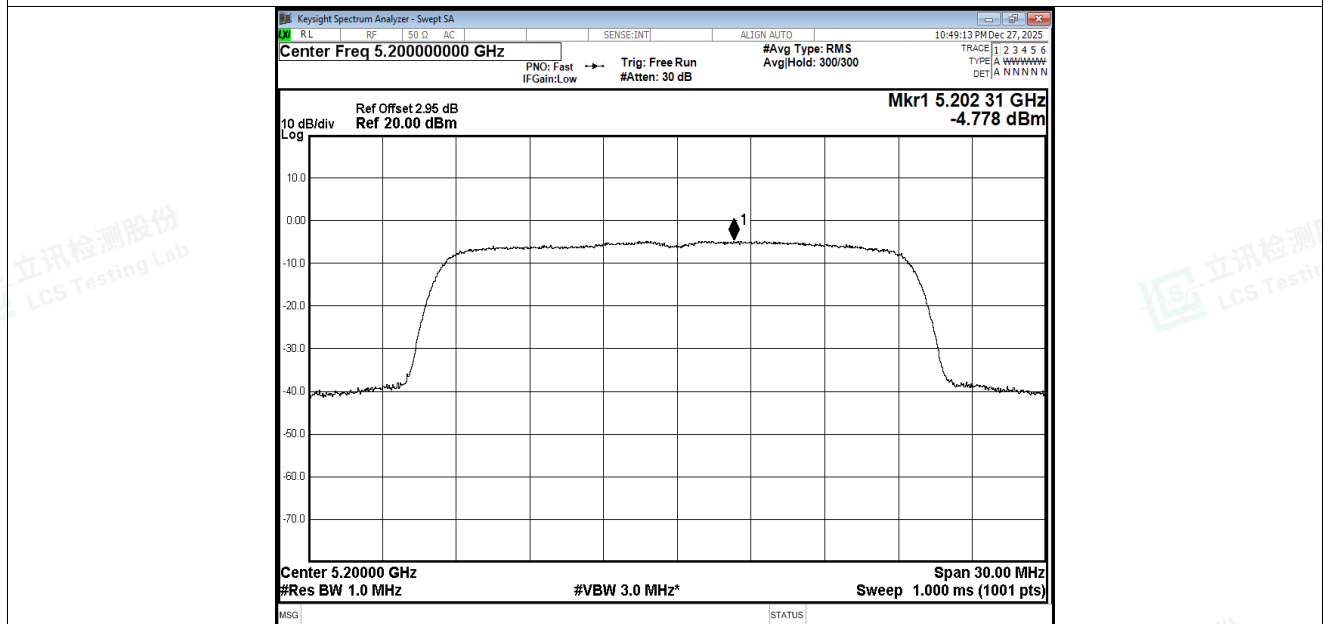


PSD NVNT be20 5200MHz Ant5



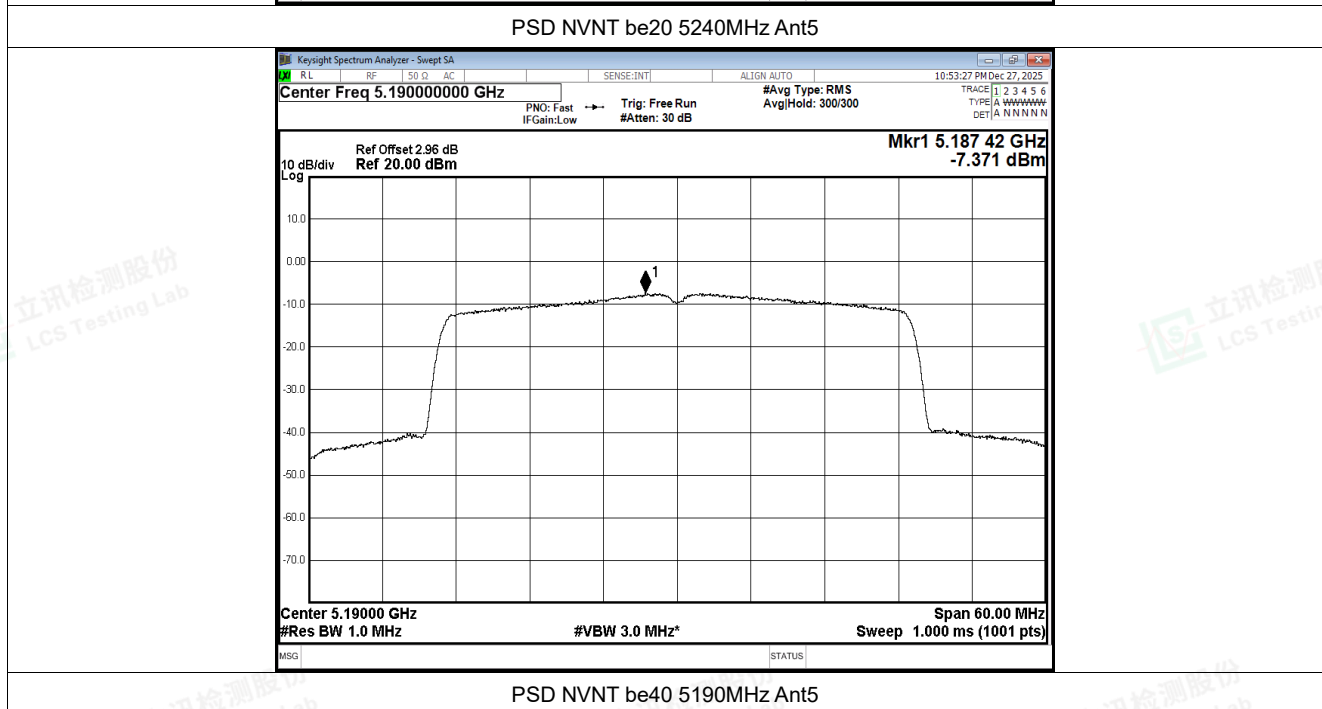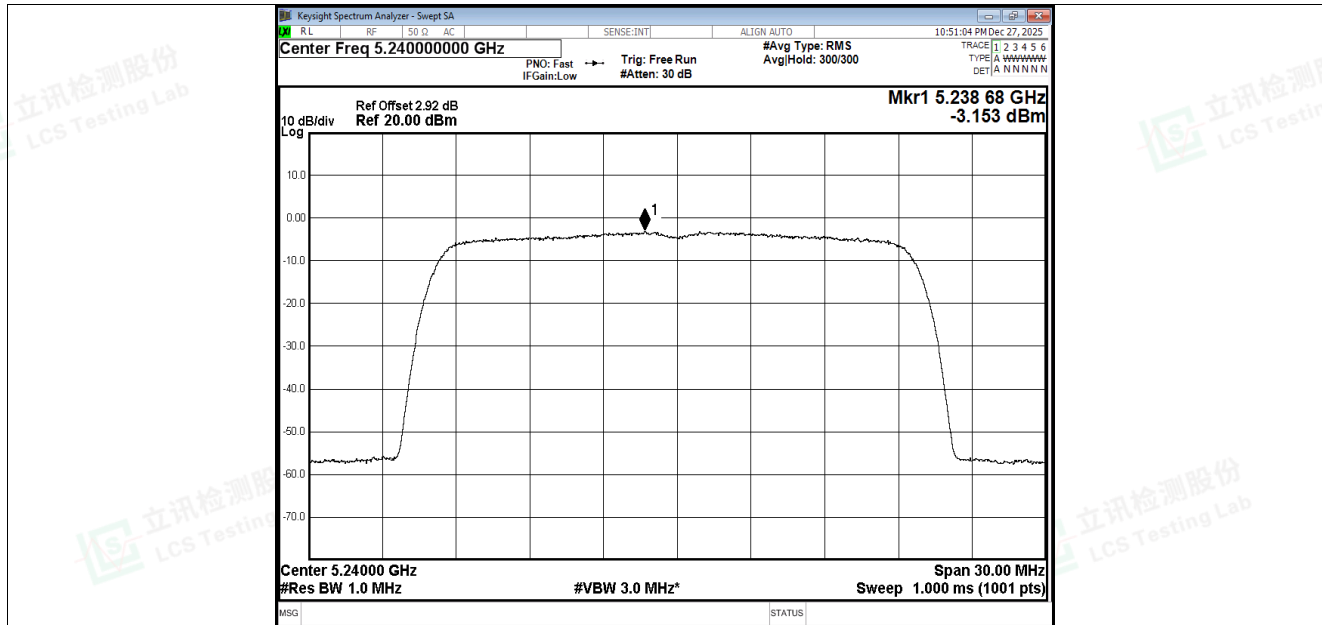

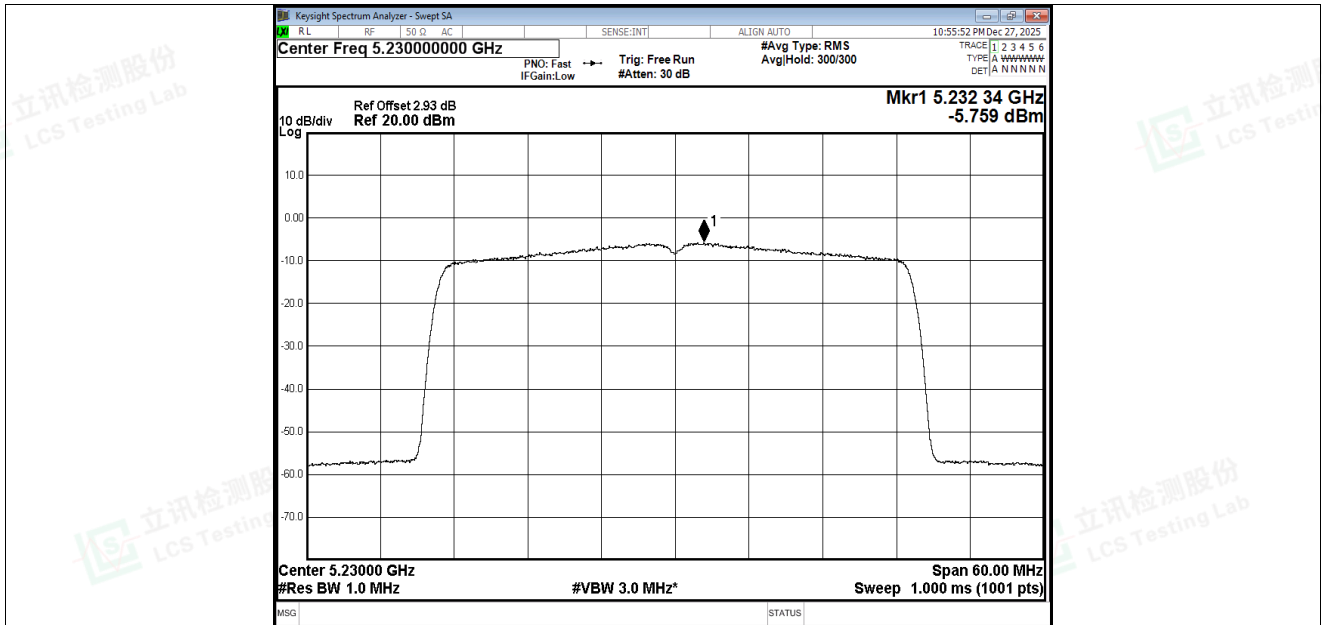


PSD NVNT be40 5230MHz Ant5

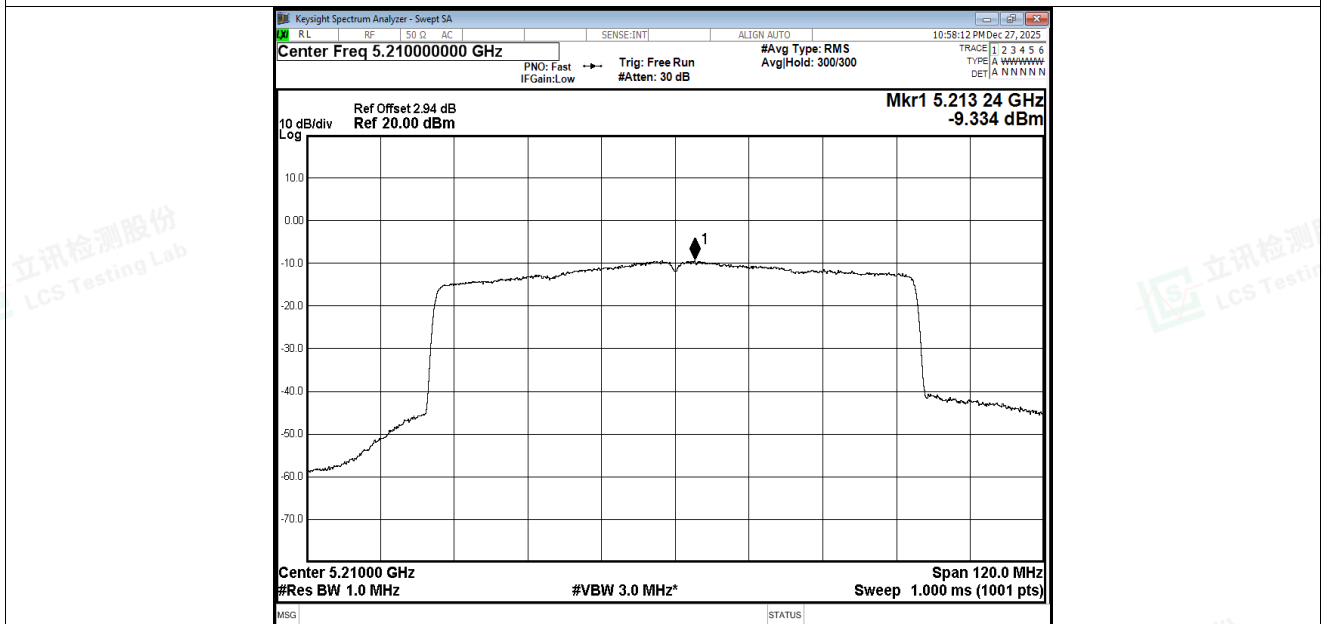

PSD NVNT be80 5210MHz Ant5



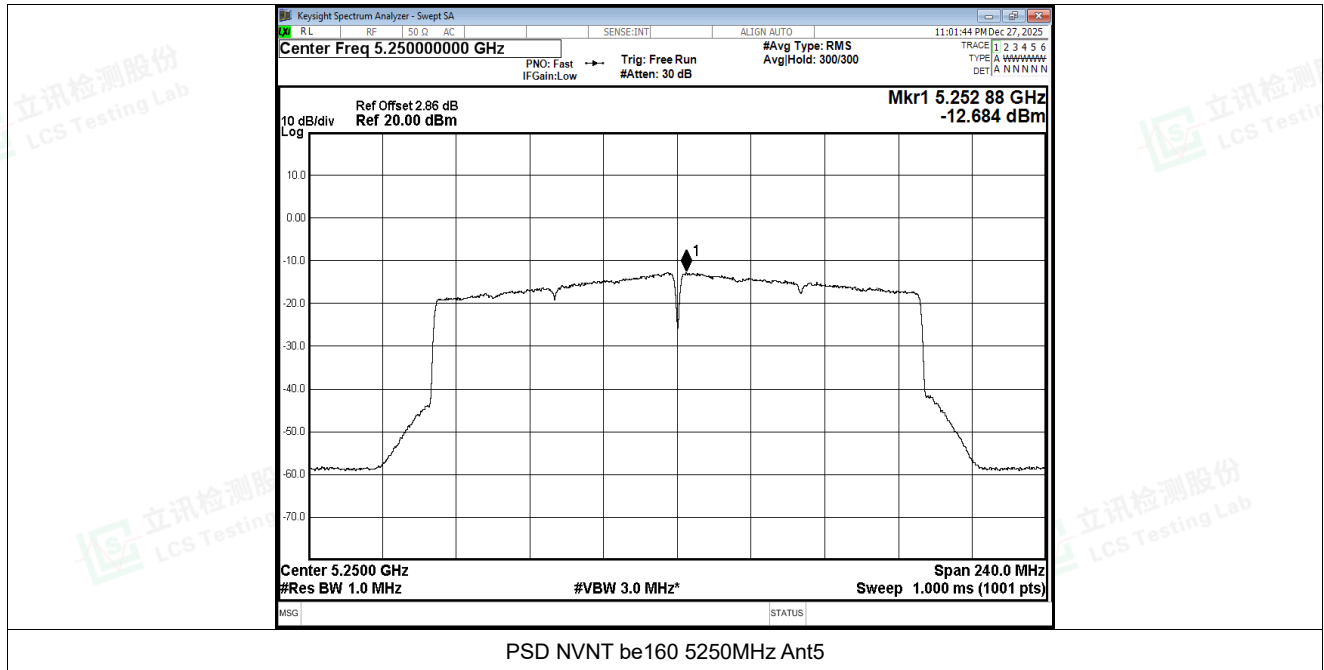



B.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant1	4500	-51.35	6.49	50.37	Peak	68.2	Pass
NVNT	a	5180	Ant1	4500	-59.02	6.49	42.7	Average	54	Pass
NVNT	a	5180	Ant1	5149.6	-45.33	6.49	56.39	Peak	68.2	Pass
NVNT	a	5180	Ant1	5149.6	-49.32	6.49	52.4	Average	54	Pass
NVNT	a	5180	Ant1	5150	-43.82	6.49	57.9	Peak	68.2	Pass
NVNT	a	5180	Ant1	5150	-48.47	6.49	53.25	Average	54	Pass
NVNT	a	5240	Ant1	5350	-49.86	6.49	51.86	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350	-56.86	6.49	44.86	Average	54	Pass
NVNT	a	5240	Ant1	5354.16	-46.05	6.49	55.67	Peak	68.2	Pass
NVNT	a	5240	Ant1	5439.6	-56.03	6.49	45.69	Average	54	Pass
NVNT	a	5240	Ant1	5460	-49.76	6.49	51.96	Peak	68.2	Pass
NVNT	a	5240	Ant1	5460	-56.5	6.49	45.22	Average	54	Pass
NVNT	n20	5180	Ant1	4500	-52.73	6.49	48.99	Peak	68.2	Pass
NVNT	n20	5180	Ant1	4500	-58.83	6.49	42.89	Average	54	Pass
NVNT	n20	5180	Ant1	5112.5	-46.17	6.49	55.55	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5148.2	-53.05	6.49	48.67	Average	54	Pass
NVNT	n20	5180	Ant1	5150	-47.22	6.49	54.5	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5150	-52.88	6.49	48.84	Average	54	Pass
NVNT	n20	5240	Ant1	5350	-47.61	6.49	54.11	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350	-57.09	6.49	44.63	Average	54	Pass
NVNT	n20	5240	Ant1	5384.16	-46.43	6.49	55.29	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5440.08	-56.07	6.49	45.65	Average	54	Pass
NVNT	n20	5240	Ant1	5460	-49.59	6.49	52.13	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5460	-56.53	6.49	45.19	Average	54	Pass
NVNT	n40	5190	Ant1	4500	-61.84	6.49	39.88	Peak	68.2	Pass
NVNT	n40	5190	Ant1	4500	-68.41	6.49	33.31	Average	54	Pass
NVNT	n40	5190	Ant1	5148.97	-47.09	6.49	54.63	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5149.7	-50.2	6.49	51.52	Average	54	Pass
NVNT	n40	5190	Ant1	5150	-46.17	6.49	55.55	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5150	-50.52	6.49	51.2	Average	54	Pass
NVNT	n40	5230	Ant1	5350	-49.55	6.49	52.17	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350	-56.63	6.49	45.09	Average	54	Pass
NVNT	n40	5230	Ant1	5371.44	-46.58	6.49	55.14	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5430.03	-55.83	6.49	45.89	Average	54	Pass
NVNT	n40	5230	Ant1	5460	-48.3	6.49	53.42	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5460	-56.31	6.49	45.41	Average	54	Pass
NVNT	ac20	5180	Ant1	4500	-50.74	6.49	50.98	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant1	4500	-58.69	6.49	43.03	Average	54	Pass
NVNT	ac20	5180	Ant1	5148.9	-45.79	6.49	55.93	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5149.6	-52.05	6.49	49.67	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-48.39	6.49	53.33	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-52.26	6.49	49.46	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-49.61	6.49	52.11	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-56.97	6.49	44.75	Average	54	Pass
NVNT	ac20	5240	Ant1	5440.32	-46.11	6.49	55.61	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5450.16	-55.67	6.49	46.05	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-48.17	6.49	53.55	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-56.34	6.49	45.38	Average	54	Pass
NVNT	ac40	5190	Ant1	4500	-52.15	6.49	49.57	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-58.27	6.49	43.45	Average	54	Pass
NVNT	ac40	5190	Ant1	5148.97	-44.72	6.49	57	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5149.7	-49.4	6.49	52.32	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-45.91	6.49	55.81	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-49.07	6.49	52.65	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-49.51	6.49	52.21	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-55.65	6.49	46.07	Average	54	Pass
NVNT	ac40	5230	Ant1	5366.85	-47.1	6.49	54.62	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5423.55	-55.1	6.49	46.62	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-47.94	6.49	53.78	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-55.89	6.49	45.83	Average	54	Pass
NVNT	ac80	5210	Ant1	5350	-49.91	6.49	51.81	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350	-55.34	6.49	46.38	Average	54	Pass
NVNT	ac80	5210	Ant1	5456.7	-46	6.49	55.72	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5372.22	-54.34	6.49	47.38	Average	54	Pass
NVNT	ac80	5210	Ant1	5460	-48.29	6.49	53.43	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5460	-55.01	6.49	46.71	Average	54	Pass
NVNT	ac80	5210	Ant1	4500	-52.14	6.49	49.58	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-58.16	6.49	43.56	Average	54	Pass
NVNT	ac80	5210	Ant1	5146.22	-44.88	6.49	56.84	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5147.8	-49.06	6.49	52.66	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-47.72	6.49	54	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-49.78	6.49	51.94	Average	54	Pass
NVNT	ac160	5250	Ant1	5350	-47.72	6.49	54	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5350	-53.25	6.49	48.47	Average	54	Pass
NVNT	ac160	5250	Ant1	5399.69	-44.86	6.49	56.86	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5397.1	-50.28	6.49	51.44	Average	54	Pass
NVNT	ac160	5250	Ant1	5460	-50.09	6.49	51.63	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5460	-55.8	6.49	45.92	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac160	5250	Ant1	4500	-52.91	6.49	48.81	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	4500	-58.38	6.49	43.34	Average	54	Pass
NVNT	ac160	5250	Ant1	5115.16	-44.81	6.49	56.91	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5126.99	-50.65	6.49	51.07	Average	54	Pass
NVNT	ac160	5250	Ant1	5150	-47.34	6.49	54.38	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5150	-52.41	6.49	49.31	Average	54	Pass
NVNT	ax20	5180	Ant1	4500	-52.48	6.49	49.24	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	4500	-58.39	6.49	43.33	Average	54	Pass
NVNT	ax20	5180	Ant1	5142.6	-46.69	6.49	55.03	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5149.6	-51.22	6.49	50.5	Average	54	Pass
NVNT	ax20	5180	Ant1	5150	-46.36	6.49	55.36	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5150	-51.63	6.49	50.09	Average	54	Pass
NVNT	ax20	5240	Ant1	5350	-48.91	6.49	52.81	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5350	-56.34	6.49	45.38	Average	54	Pass
NVNT	ax20	5240	Ant1	5416.32	-46.26	6.49	55.46	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5459.04	-55.37	6.49	46.35	Average	54	Pass
NVNT	ax20	5240	Ant1	5460	-48.11	6.49	53.61	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5460	-55.69	6.49	46.03	Average	54	Pass
NVNT	ax40	5190	Ant1	4500	-51.42	6.49	50.3	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	4500	-58.57	6.49	43.15	Average	54	Pass
NVNT	ax40	5190	Ant1	5147.51	-45.02	6.49	56.7	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5149.7	-49.57	6.49	52.15	Average	54	Pass
NVNT	ax40	5190	Ant1	5150	-45.24	6.49	56.48	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5150	-49.09	6.49	52.63	Average	54	Pass
NVNT	ax40	5230	Ant1	5350	-49.96	6.49	51.76	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5350	-56.24	6.49	45.48	Average	54	Pass
NVNT	ax40	5230	Ant1	5444.61	-46.07	6.49	55.65	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5435.43	-55.5	6.49	46.22	Average	54	Pass
NVNT	ax40	5230	Ant1	5460	-50.09	6.49	51.63	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5460	-56.15	6.49	45.57	Average	54	Pass
NVNT	ax80	5210	Ant1	5350	-50.28	6.49	51.44	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5350	-55.48	6.49	46.24	Average	54	Pass
NVNT	ax80	5210	Ant1	5436.57	-47.19	6.49	54.53	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5401.26	-55.16	6.49	46.56	Average	54	Pass
NVNT	ax80	5210	Ant1	5460	-48.01	6.49	53.71	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5460	-55.84	6.49	45.88	Average	54	Pass
NVNT	ax80	5210	Ant1	4500	-50.82	6.49	50.9	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	4500	-58.55	6.49	43.17	Average	54	Pass
NVNT	ax80	5210	Ant1	5147.01	-44.36	6.49	57.36	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5148.59	-49.85	6.49	51.87	Average	54	Pass
NVNT	ax80	5210	Ant1	5150	-48.16	6.49	53.56	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5210	Ant1	5150	-49.3	6.49	52.42	Average	54	Pass
NVNT	ax160	5250	Ant1	5350	-49.99	6.49	51.73	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5350	-54.2	6.49	47.52	Average	54	Pass
NVNT	ax160	5250	Ant1	5408.57	-45.19	6.49	56.53	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5407.46	-52.93	6.49	48.79	Average	54	Pass
NVNT	ax160	5250	Ant1	5460	-48.68	6.49	53.04	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5460	-55.6	6.49	46.12	Average	54	Pass
NVNT	ax160	5250	Ant1	4500	-51.75	6.49	49.97	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	4500	-58.37	6.49	43.35	Average	54	Pass
NVNT	ax160	5250	Ant1	5097.87	-45.7	6.49	56.02	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5126.08	-52.21	6.49	49.51	Average	54	Pass
NVNT	ax160	5250	Ant1	5150	-49.42	6.49	52.3	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5150	-52.28	6.49	49.44	Average	54	Pass
NVNT	be20	5180	Ant1	4500	-52.17	6.49	49.55	Peak	68.2	Pass
NVNT	be20	5180	Ant1	4500	-58.5	6.49	43.22	Average	54	Pass
NVNT	be20	5180	Ant1	5148.9	-46.06	6.49	55.66	Peak	68.2	Pass
NVNT	be20	5180	Ant1	5149.6	-51.71	6.49	50.01	Average	54	Pass
NVNT	be20	5180	Ant1	5150	-48.32	6.49	53.4	Peak	68.2	Pass
NVNT	be20	5180	Ant1	5150	-51.69	6.49	50.03	Average	54	Pass
NVNT	be20	5240	Ant1	5350	-49.81	6.49	51.91	Peak	68.2	Pass
NVNT	be20	5240	Ant1	5350	-56.36	6.49	45.36	Average	54	Pass
NVNT	be20	5240	Ant1	5353.92	-47.3	6.49	54.42	Peak	68.2	Pass
NVNT	be20	5240	Ant1	5440.32	-55.41	6.49	46.31	Average	54	Pass
NVNT	be20	5240	Ant1	5460	-49.29	6.49	52.43	Peak	68.2	Pass
NVNT	be20	5240	Ant1	5460	-55.94	6.49	45.78	Average	54	Pass
NVNT	be40	5190	Ant1	4500	-52.24	6.49	49.48	Peak	68.2	Pass
NVNT	be40	5190	Ant1	4500	-58.51	6.49	43.21	Average	54	Pass
NVNT	be40	5190	Ant1	5145.32	-44.16	6.49	57.56	Peak	68.2	Pass
NVNT	be40	5190	Ant1	5149.7	-49.37	6.49	52.35	Average	54	Pass
NVNT	be40	5190	Ant1	5150	-45.6	6.49	56.12	Peak	68.2	Pass
NVNT	be40	5190	Ant1	5150	-48.84	6.49	52.88	Average	54	Pass
NVNT	be40	5230	Ant1	5350	-49.82	6.49	51.9	Peak	68.2	Pass
NVNT	be40	5230	Ant1	5350	-55.86	6.49	45.86	Average	54	Pass
NVNT	be40	5230	Ant1	5410.86	-47.21	6.49	54.51	Peak	68.2	Pass
NVNT	be40	5230	Ant1	5444.88	-55.27	6.49	46.45	Average	54	Pass
NVNT	be40	5230	Ant1	5460	-50.12	6.49	51.6	Peak	68.2	Pass
NVNT	be40	5230	Ant1	5460	-56.04	6.49	45.68	Average	54	Pass
NVNT	be80	5210	Ant1	5350	-50.62	6.49	51.1	Peak	68.2	Pass
NVNT	be80	5210	Ant1	5350	-56.02	6.49	45.7	Average	54	Pass
NVNT	be80	5210	Ant1	5420.73	-45.99	6.49	55.73	Peak	68.2	Pass
NVNT	be80	5210	Ant1	5374.2	-55.21	6.49	46.51	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be80	5210	Ant1	5460	-48.29	6.49	53.43	Peak	68.2	Pass
NVNT	be80	5210	Ant1	5460	-55.52	6.49	46.2	Average	54	Pass
NVNT	be80	5210	Ant1	4500	-51.23	6.49	50.49	Peak	68.2	Pass
NVNT	be80	5210	Ant1	4500	-58.54	6.49	43.18	Average	54	Pass
NVNT	be80	5210	Ant1	5146.22	-45.15	6.49	56.57	Peak	68.2	Pass
NVNT	be80	5210	Ant1	5148.59	-49.84	6.49	51.88	Average	54	Pass
NVNT	be80	5210	Ant1	5150	-46.75	6.49	54.97	Peak	68.2	Pass
NVNT	be80	5210	Ant1	5150	-49.98	6.49	51.74	Average	54	Pass
NVNT	be160	5250	Ant1	5350	-49.7	6.49	52.02	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5350	-53.85	6.49	47.87	Average	54	Pass
NVNT	be160	5250	Ant1	5394.14	-44.75	6.49	56.97	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5403.39	-52.75	6.49	48.97	Average	54	Pass
NVNT	be160	5250	Ant1	5460	-48.8	6.49	52.92	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5460	-55.58	6.49	46.14	Average	54	Pass
NVNT	be160	5250	Ant1	4500	-52.31	6.49	49.41	Peak	68.2	Pass
NVNT	be160	5250	Ant1	4500	-58.5	6.49	43.22	Average	54	Pass
NVNT	be160	5250	Ant1	5126.99	-45.94	6.49	55.78	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5126.08	-52.21	6.49	49.51	Average	54	Pass
NVNT	be160	5250	Ant1	5150	-48.46	6.49	53.26	Peak	68.2	Pass
NVNT	be160	5250	Ant1	5150	-51.96	6.49	49.76	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

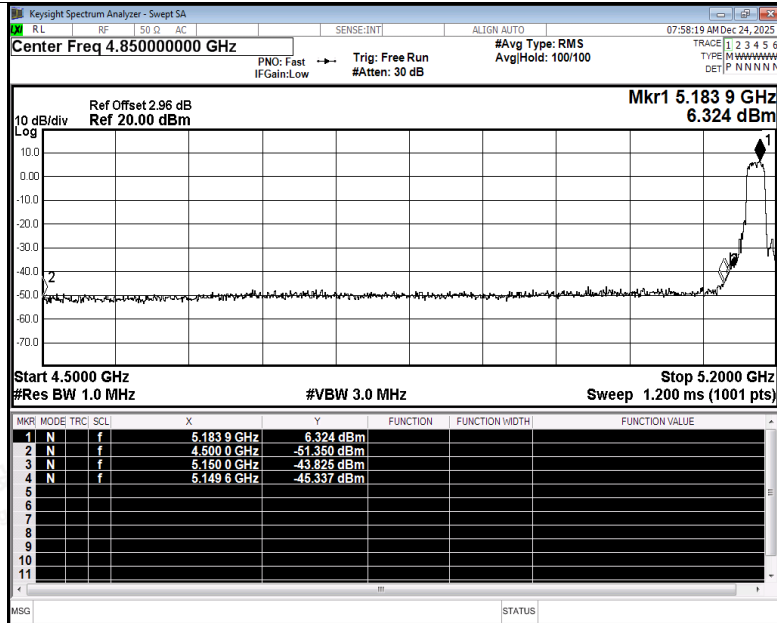

Restrict Band NVNT a 5180MHz Ant1 Peak

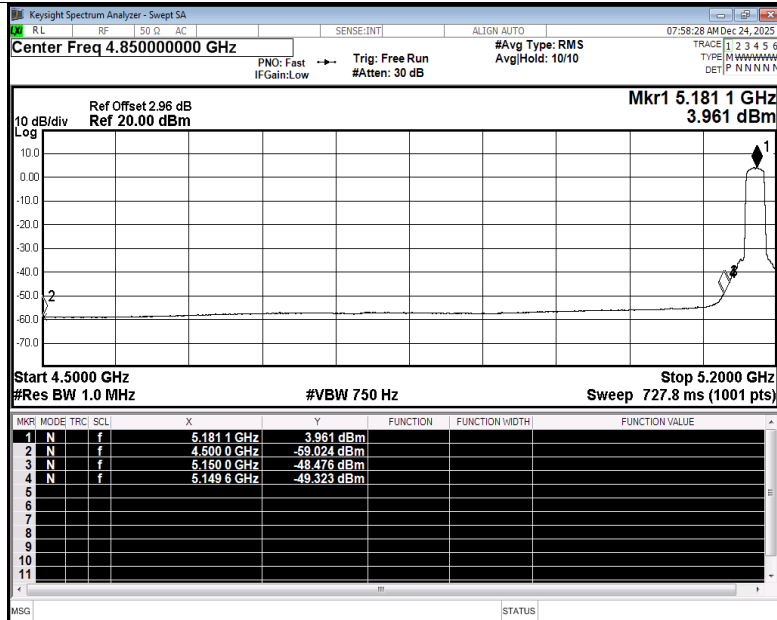

Restrict Band NVNT a 5180MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

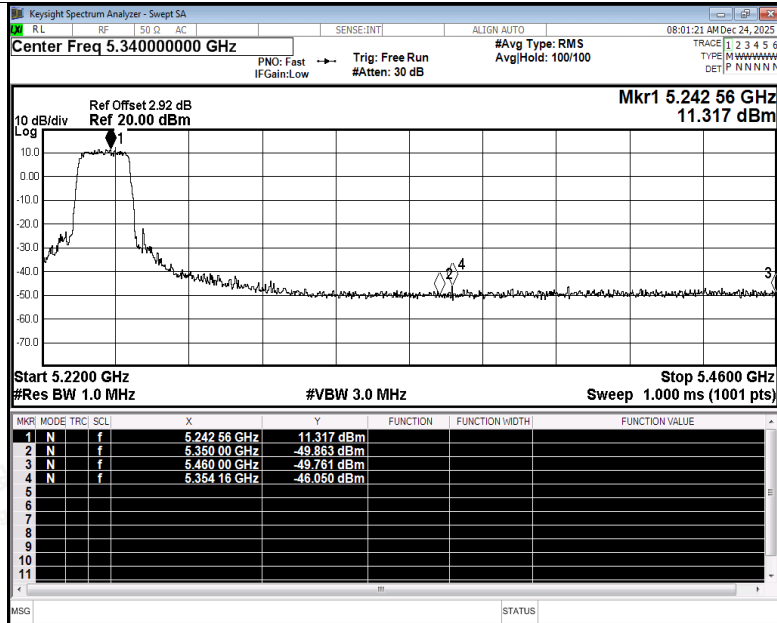

Restrict Band NVNT a 5240MHz Ant1 Peak

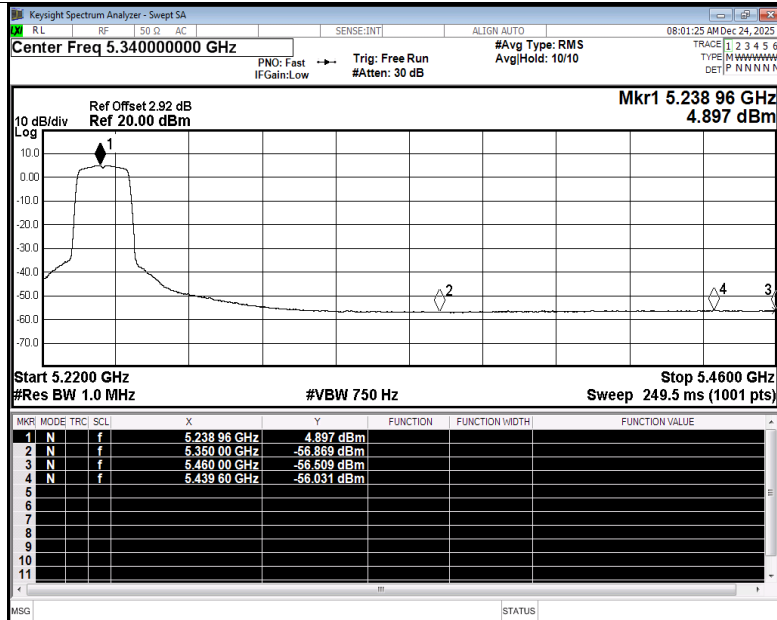

Restrict Band NVNT a 5240MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

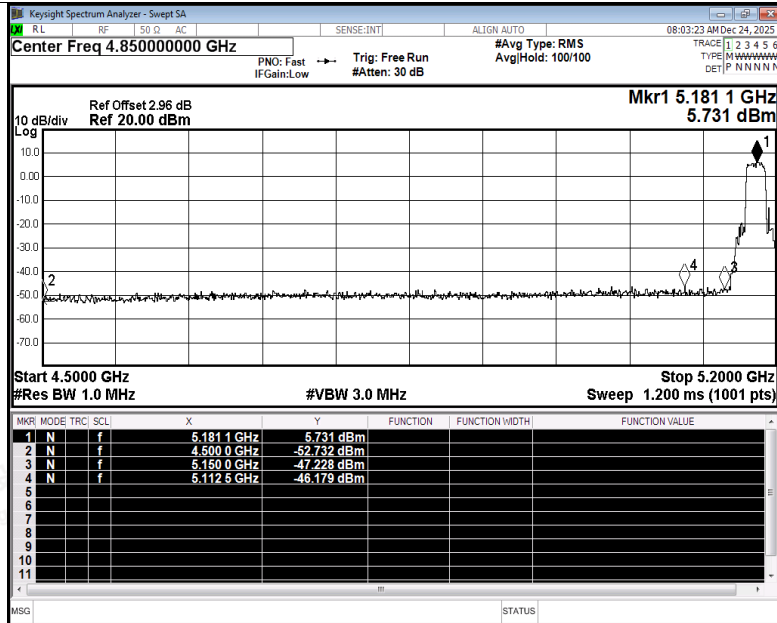

Restrict Band NVNT n20 5180MHz Ant1 Peak

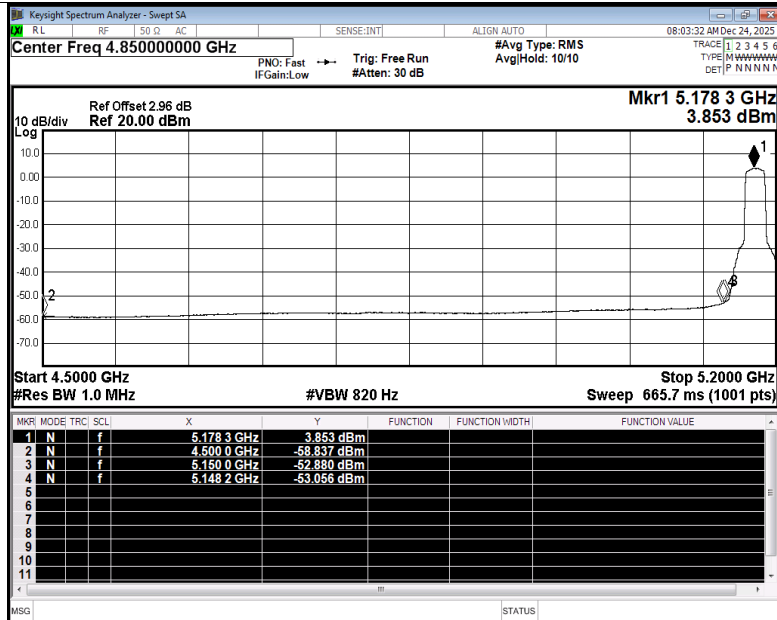

Restrict Band NVNT n20 5180MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

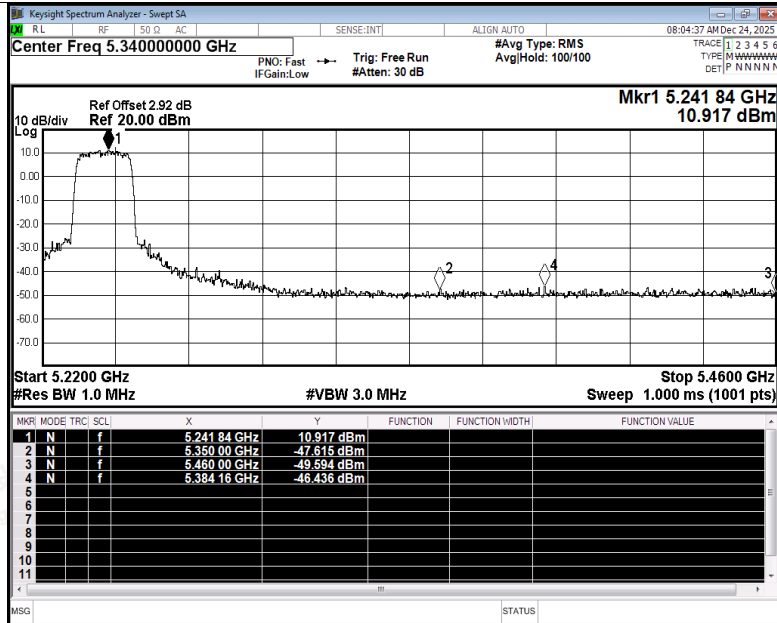

Restrict Band NVNT n20 5240MHz Ant1 Peak

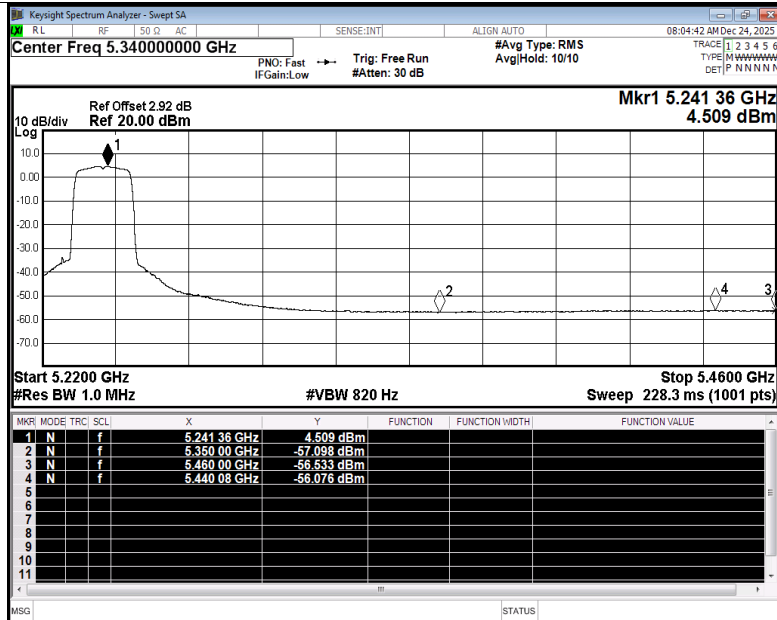

Restrict Band NVNT n20 5240MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

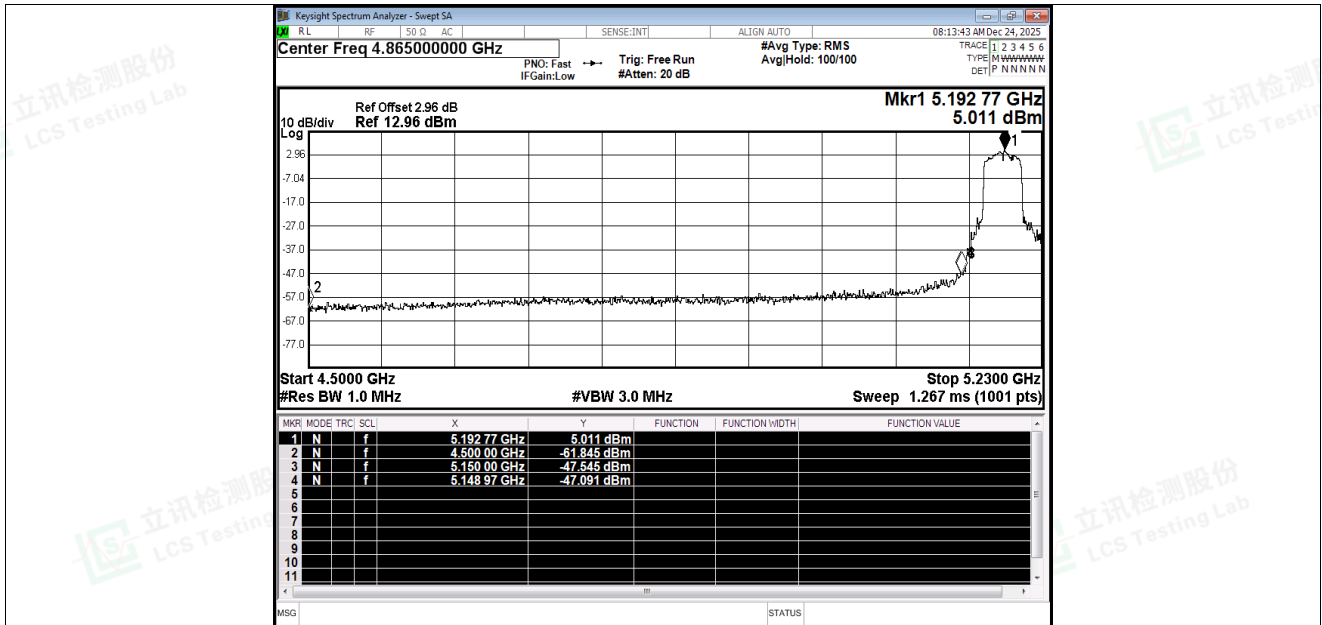


Restrict Band NVNT n40 5190MHz Ant1 Peak

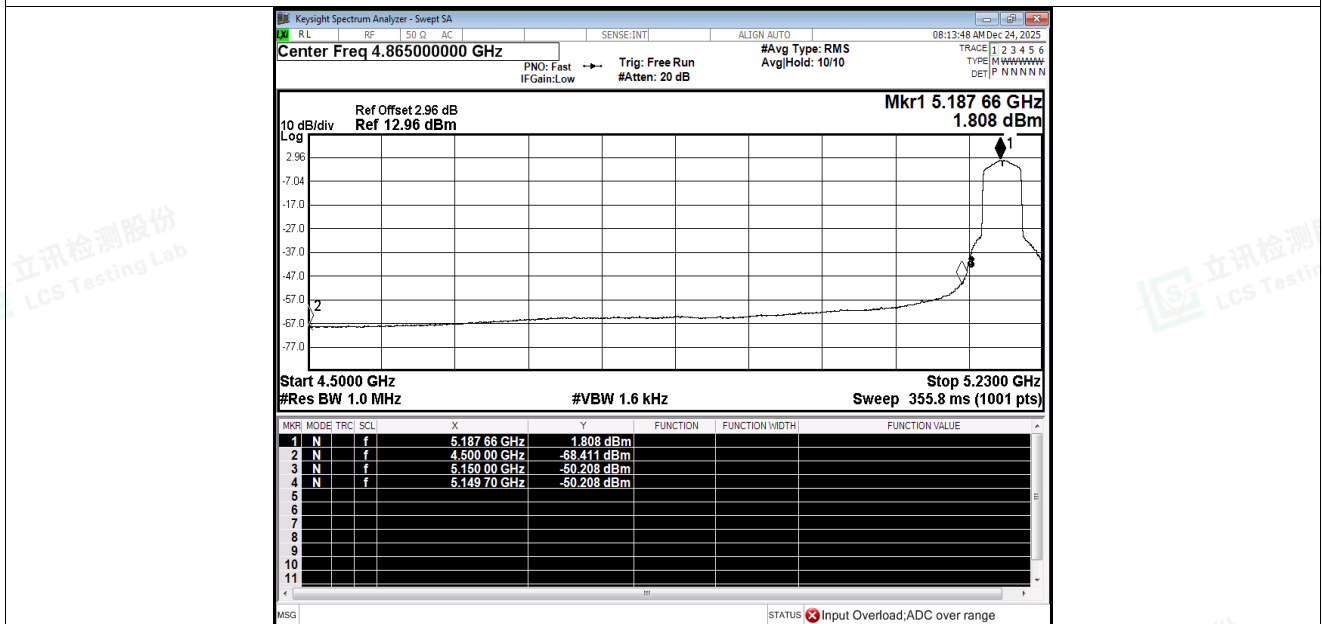


Restrict Band NVNT n40 5190MHz Ant1 Average



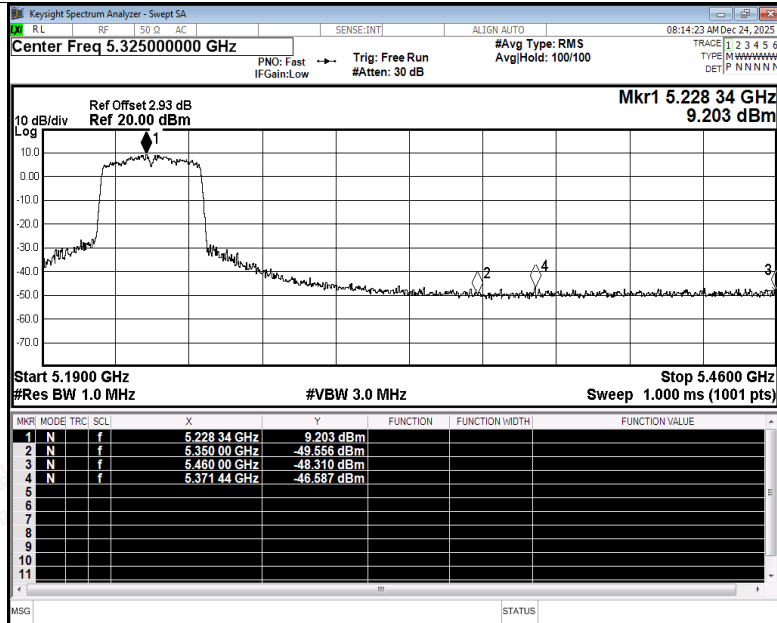

Restrict Band NVNT n40 5230MHz Ant1 Peak

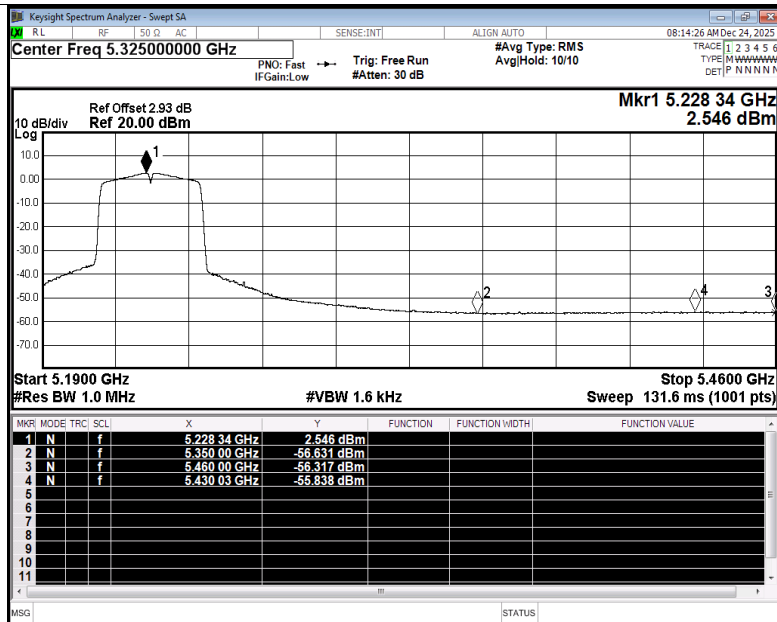

Restrict Band NVNT n40 5230MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

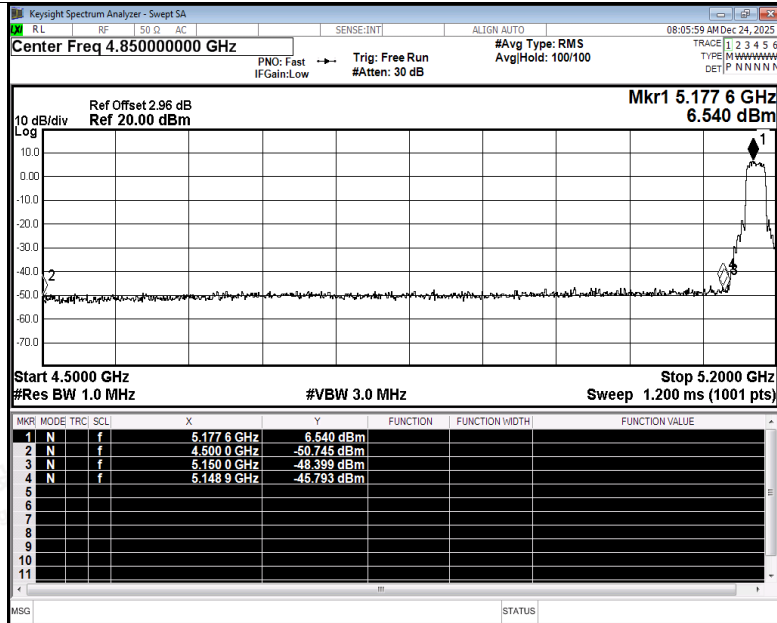

Restrict Band NVNT ac20 5180MHz Ant1 Peak

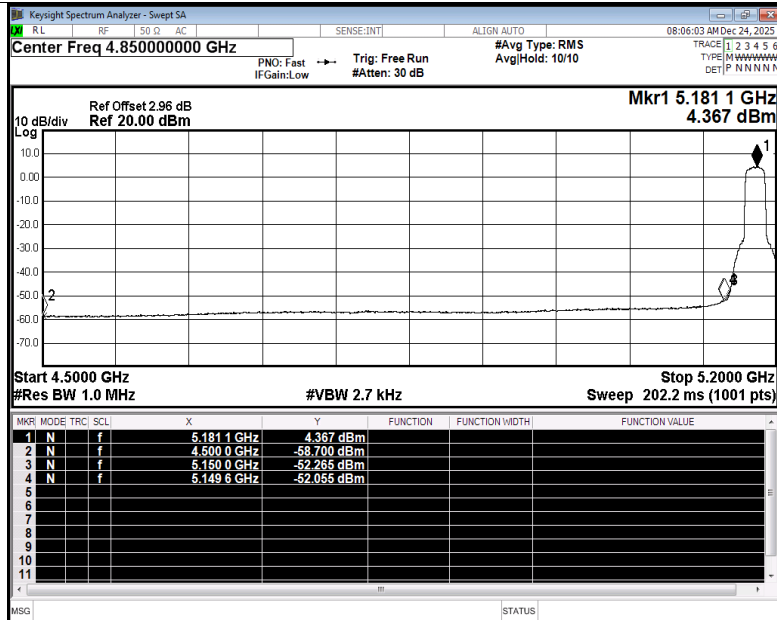

Restrict Band NVNT ac20 5180MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

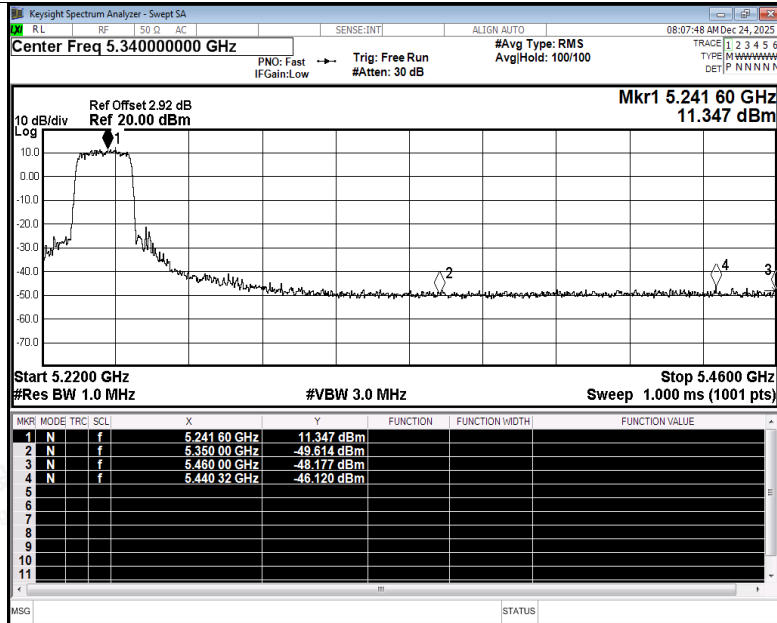

Restrict Band NVNT ac20 5240MHz Ant1 Peak

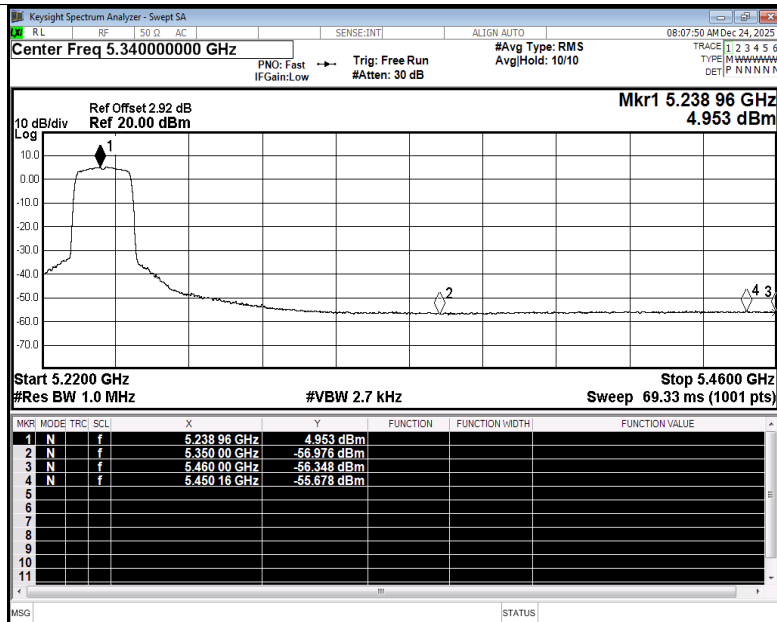

Restrict Band NVNT ac20 5240MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

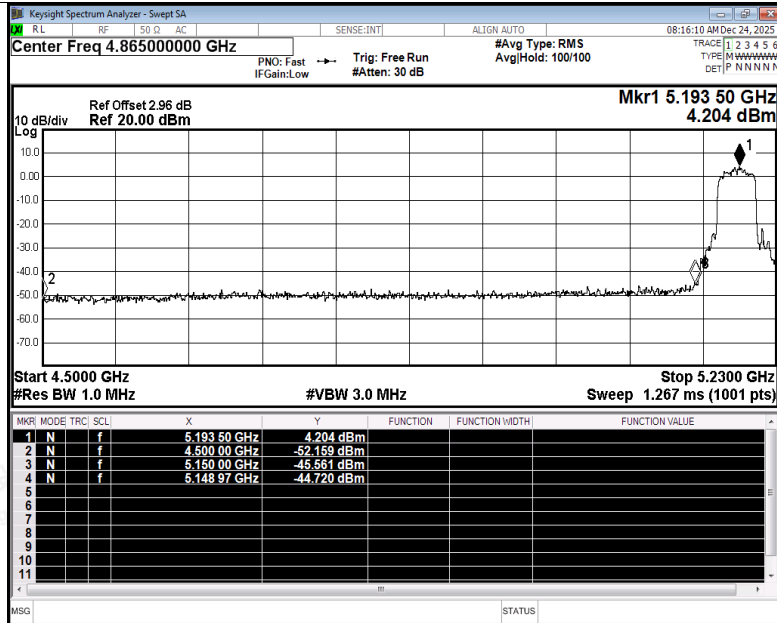


Restrict Band NVNT ac40 5190MHz Ant1 Peak

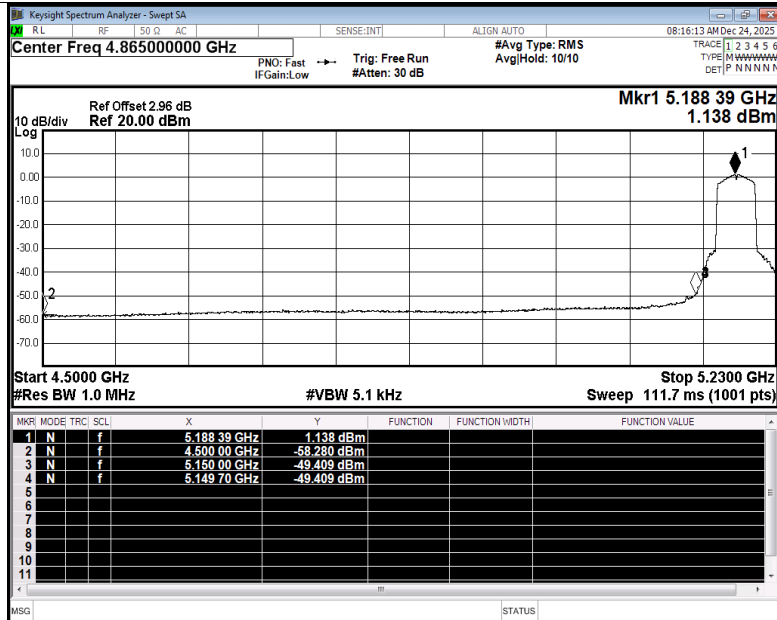


Restrict Band NVNT ac40 5190MHz Ant1 Average



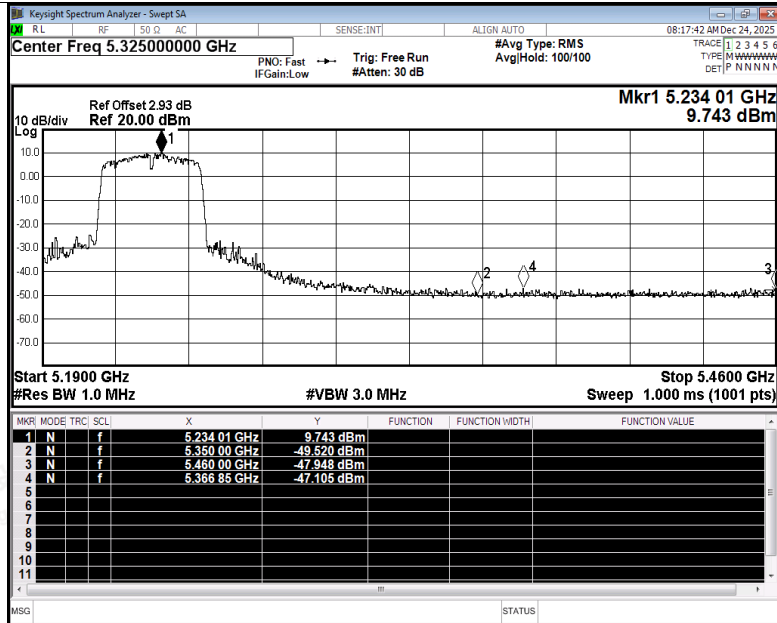


Restrict Band NVNT ac40 5230MHz Ant1 Peak

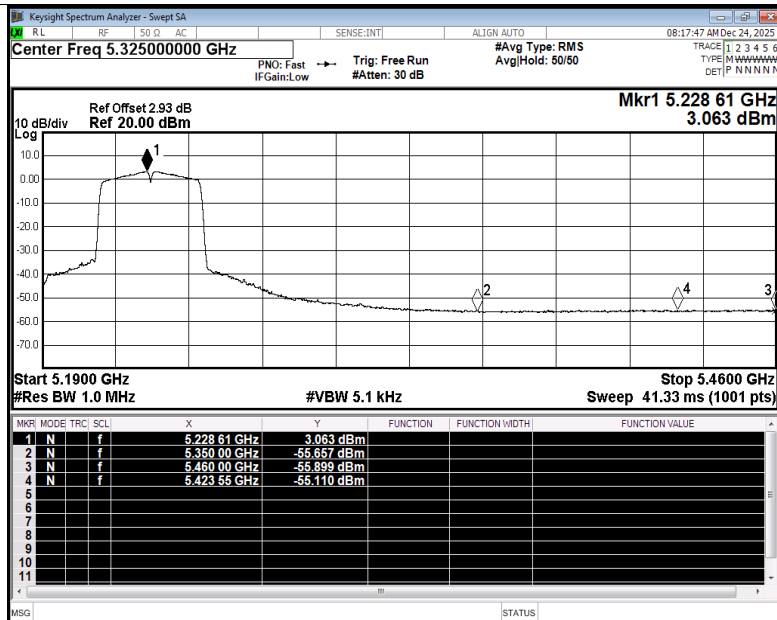


Restrict Band NVNT ac40 5230MHz Ant1 Average



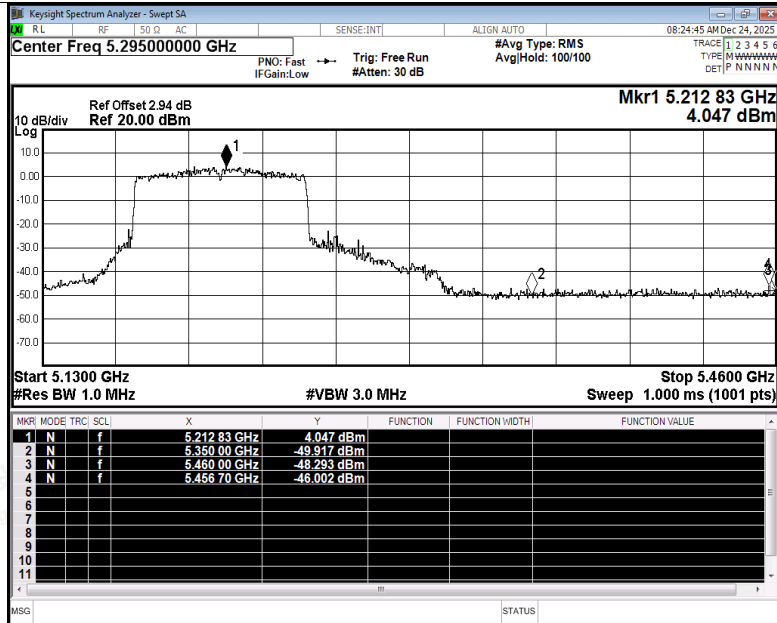

Restrict Band NVNT ac80 5210MHz Ant1 Peak

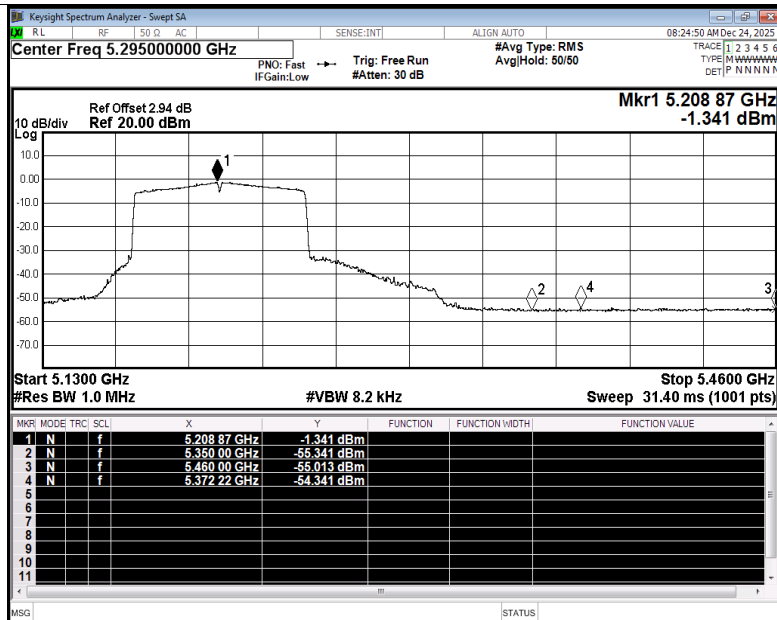

Restrict Band NVNT ac80 5210MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

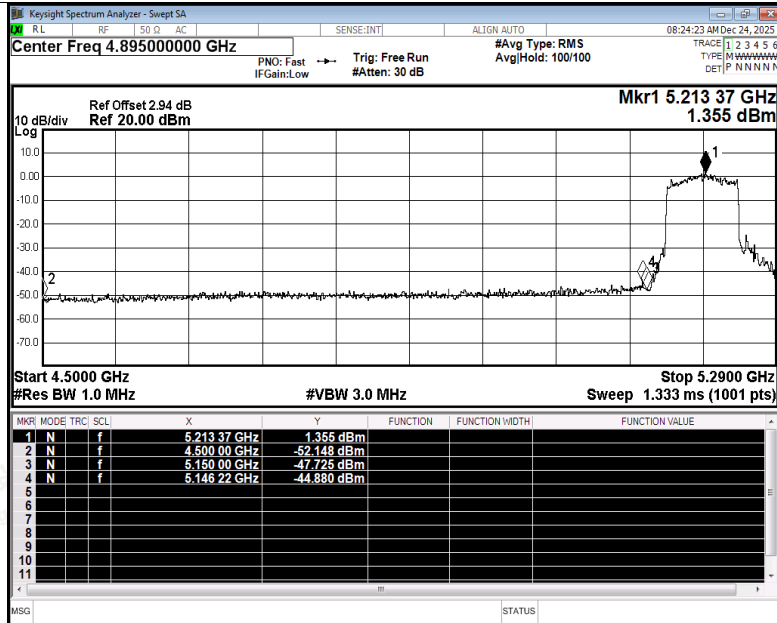

Restrict Band NVNT ac80 5210MHz Ant1 Peak

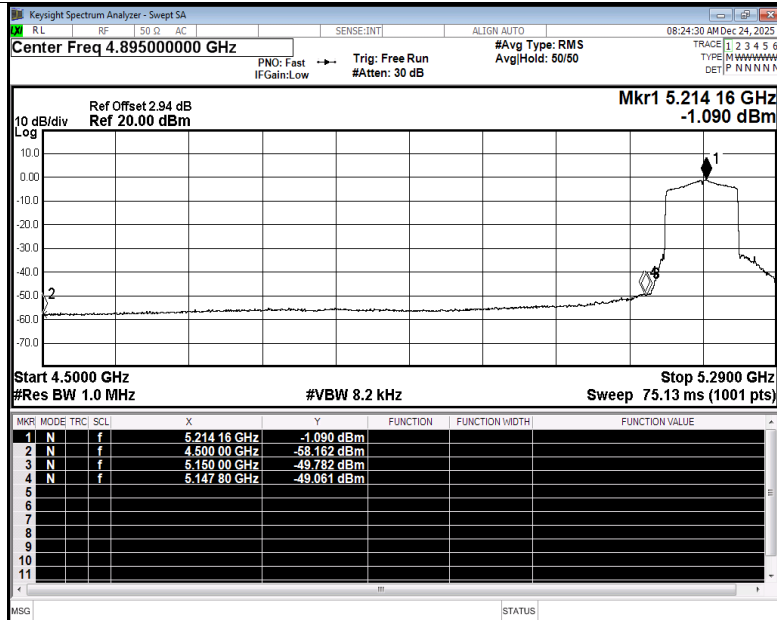

Restrict Band NVNT ac80 5210MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

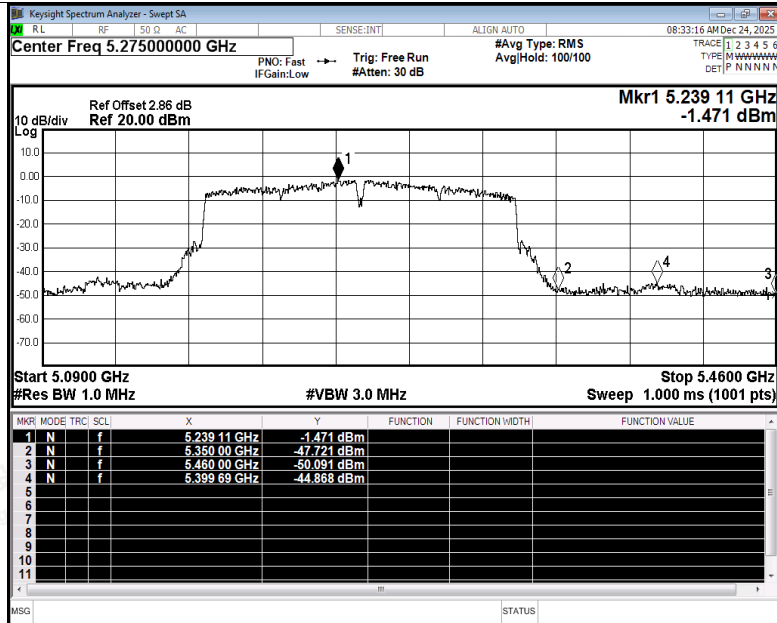

Restrict Band NVNT ac160 5250MHz Ant1 Peak

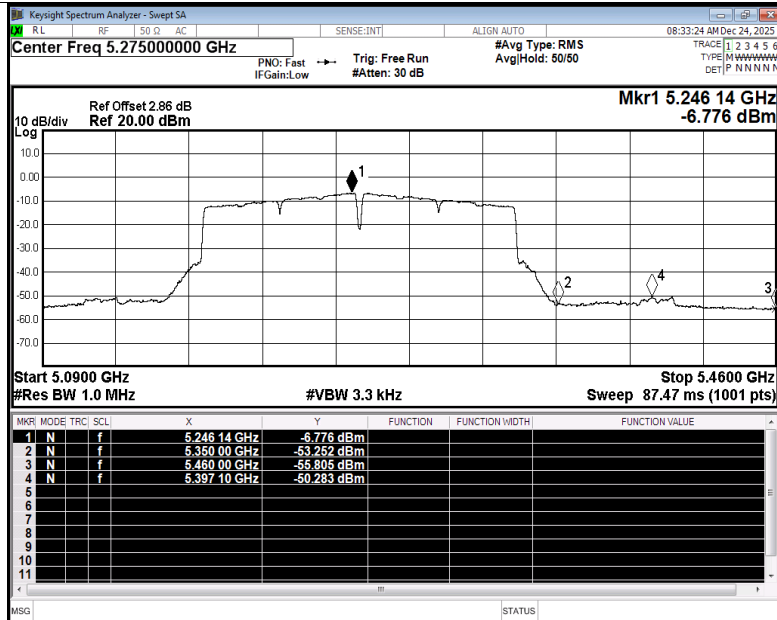

Restrict Band NVNT ac160 5250MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

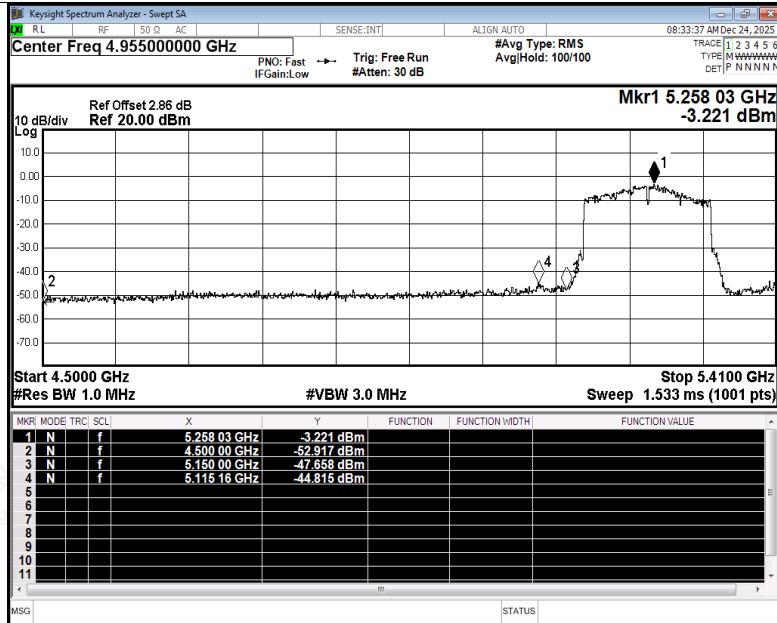


Restrict Band NVNT ac160 5250MHz Ant1 Peak

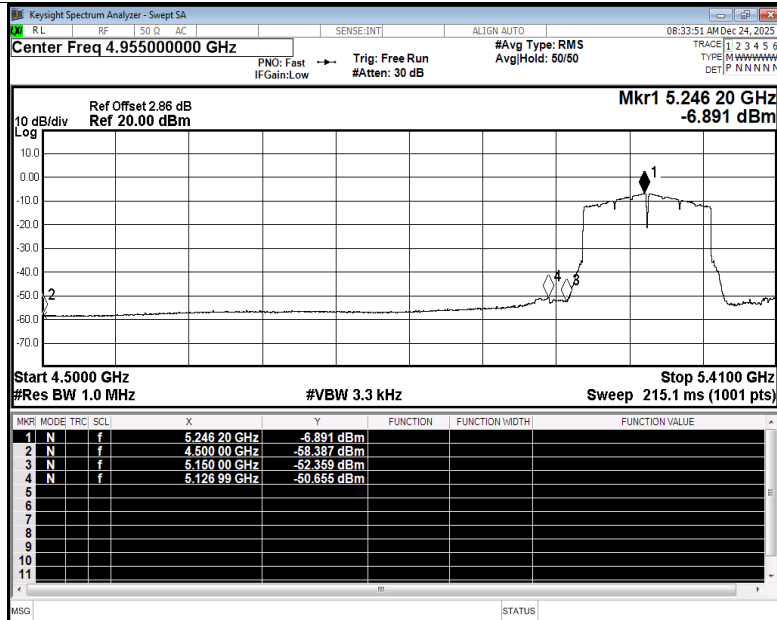


Restrict Band NVNT ac160 5250MHz Ant1 Average



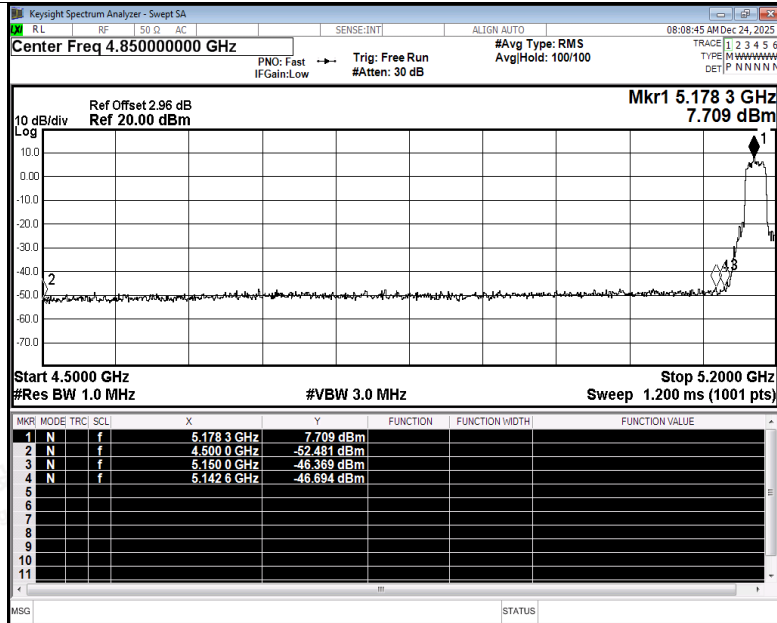

Restrict Band NVNT ax20 5180MHz Ant1 Peak

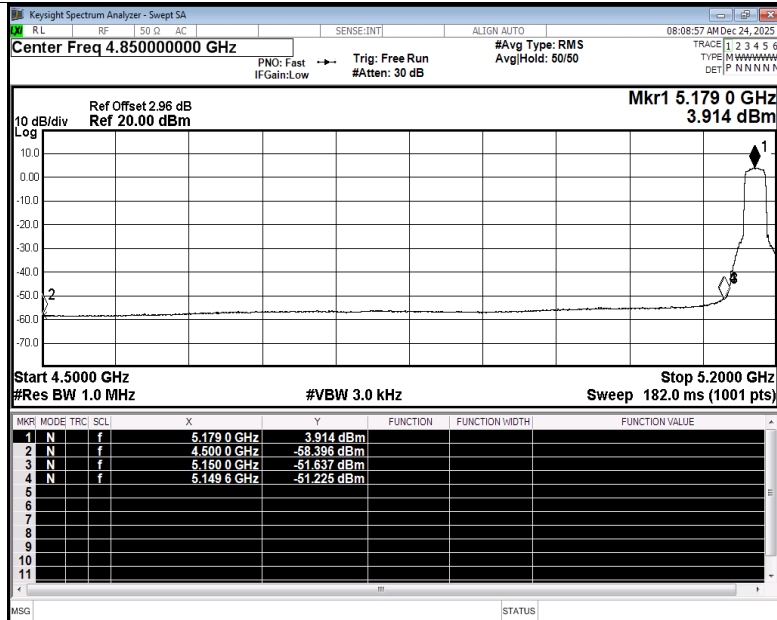

Restrict Band NVNT ax20 5180MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

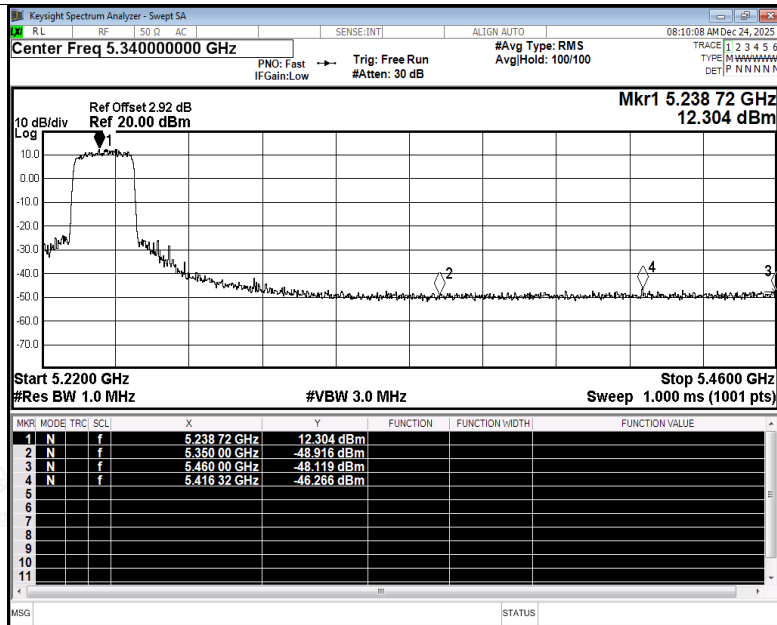


Restrict Band NVNT ax20 5240MHz Ant1 Peak

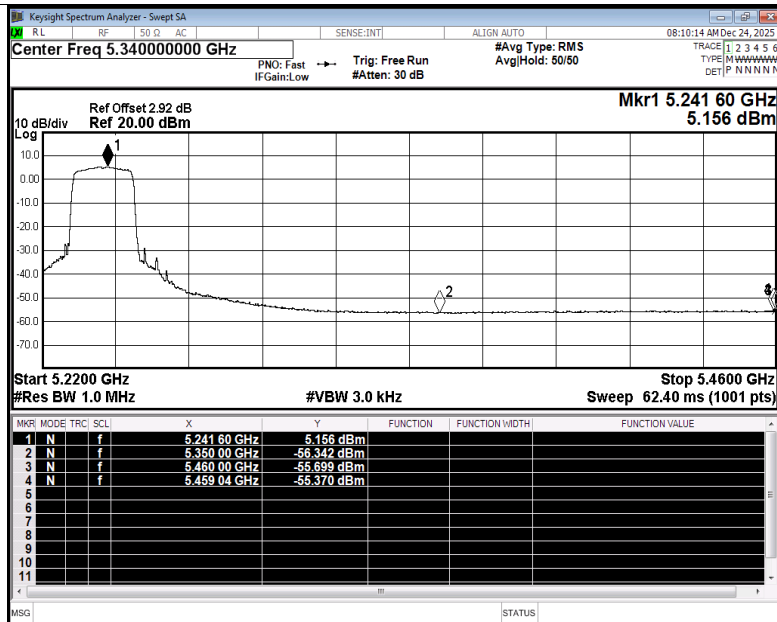


Restrict Band NVNT ax20 5240MHz Ant1 Average



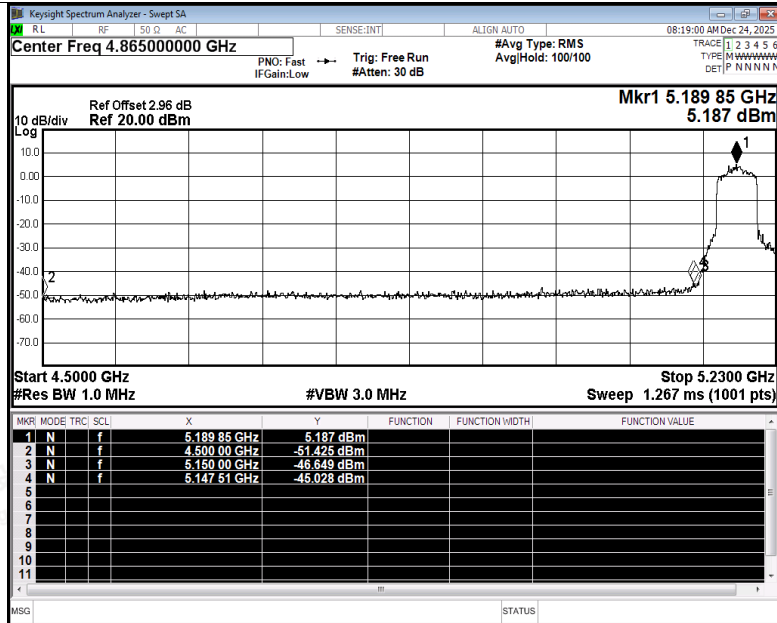

Restrict Band NVNT ax40 5190MHz Ant1 Peak

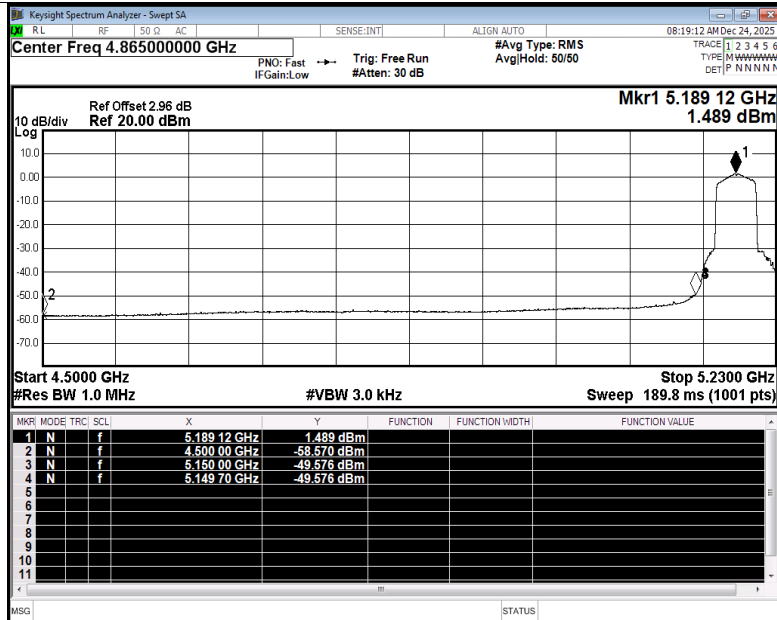

Restrict Band NVNT ax40 5190MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

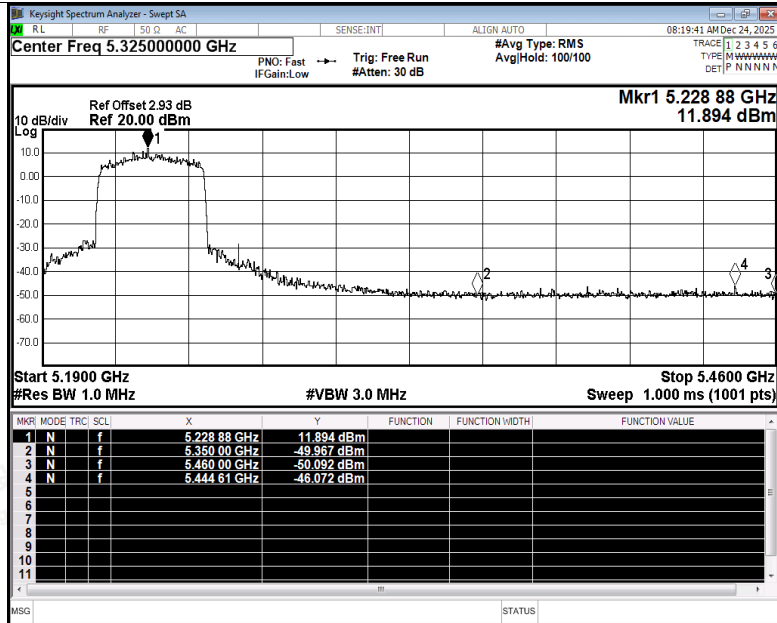

Restrict Band NVNT ax40 5230MHz Ant1 Peak

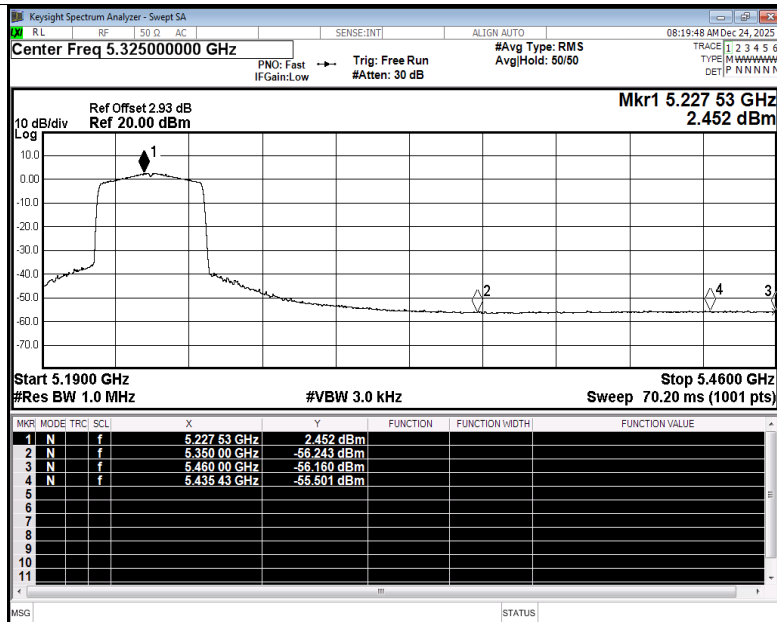

Restrict Band NVNT ax40 5230MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

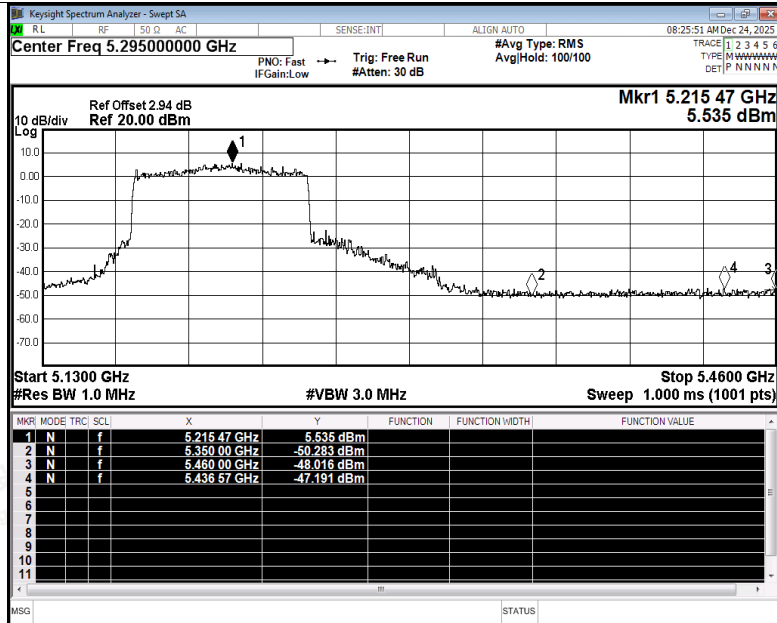


Restrict Band NVNT ax80 5210MHz Ant1 Peak

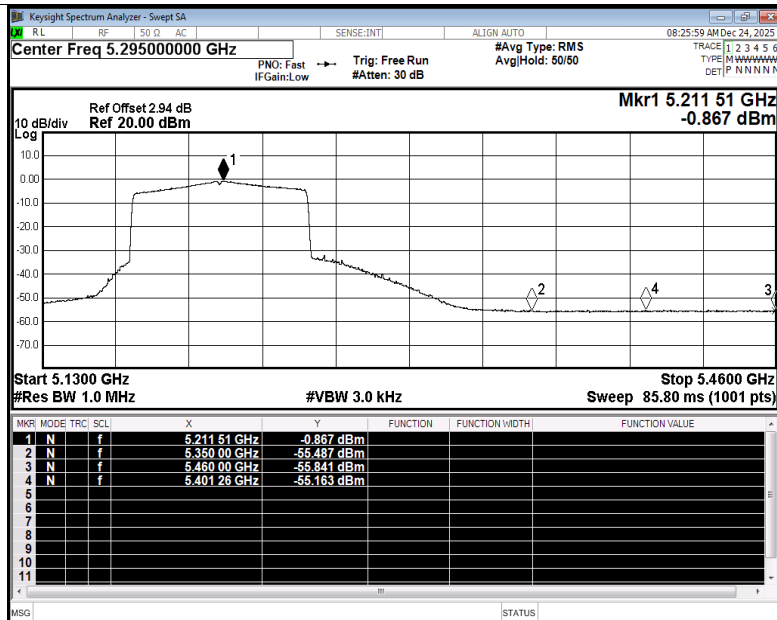


Restrict Band NVNT ax80 5210MHz Ant1 Average



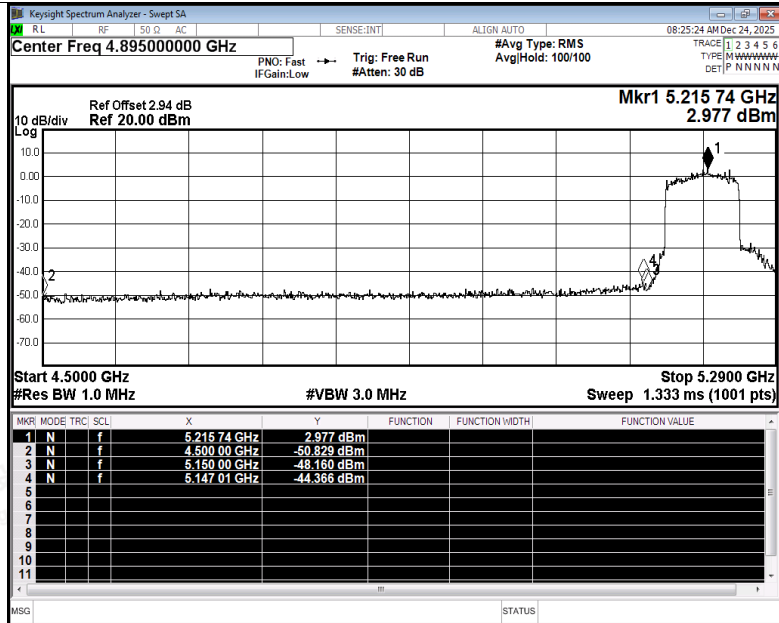

Restrict Band NVNT ax80 5210MHz Ant1 Peak

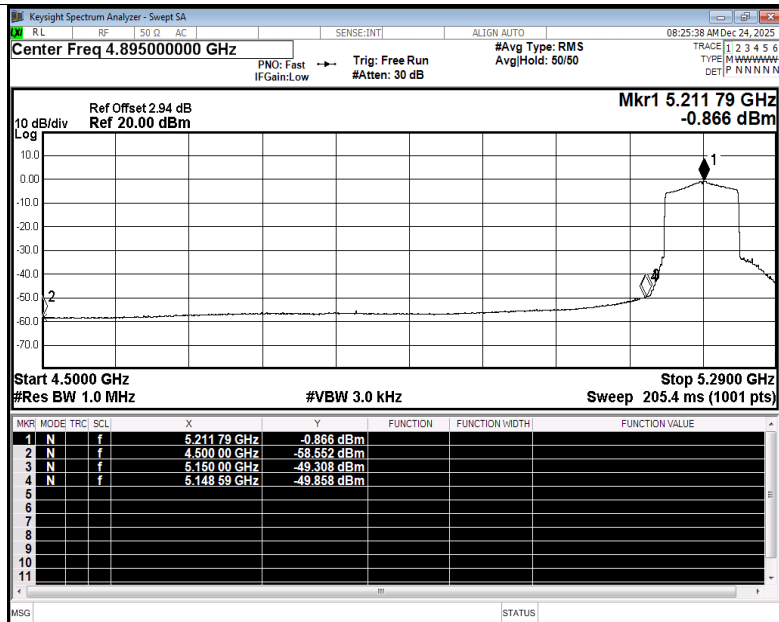

Restrict Band NVNT ax80 5210MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

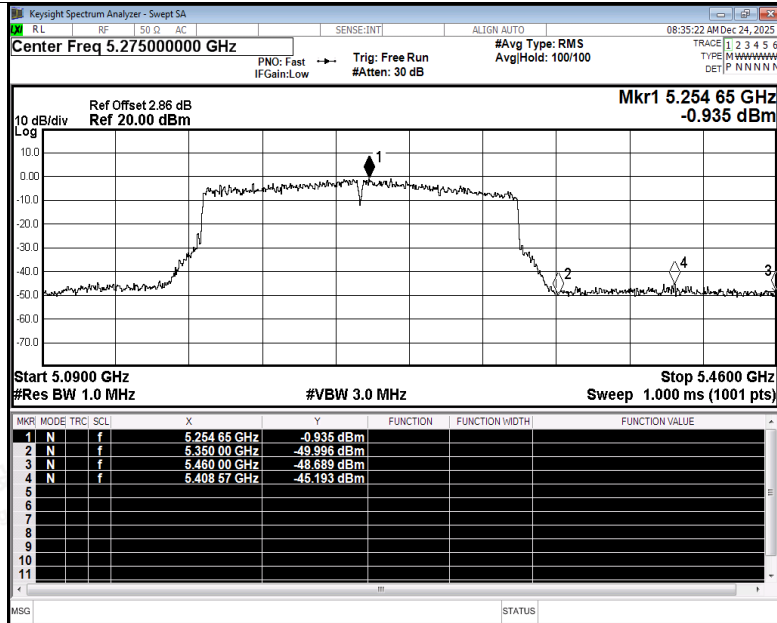

Restrict Band NVNT ax160 5250MHz Ant1 Peak

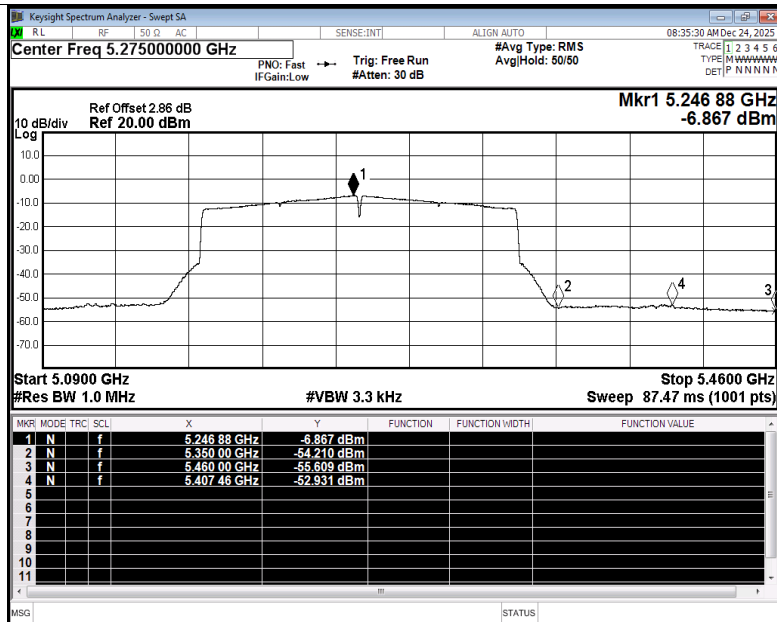

Restrict Band NVNT ax160 5250MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

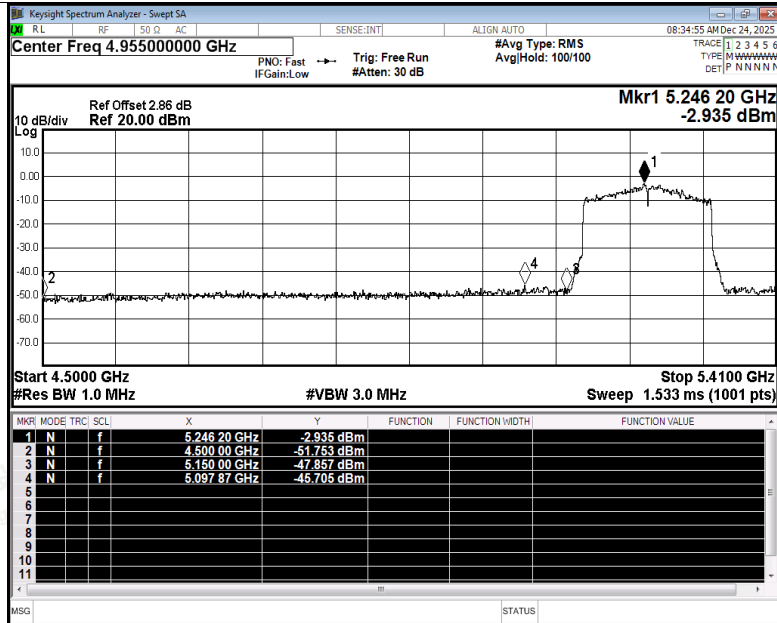

Restrict Band NVNT ax160 5250MHz Ant1 Peak

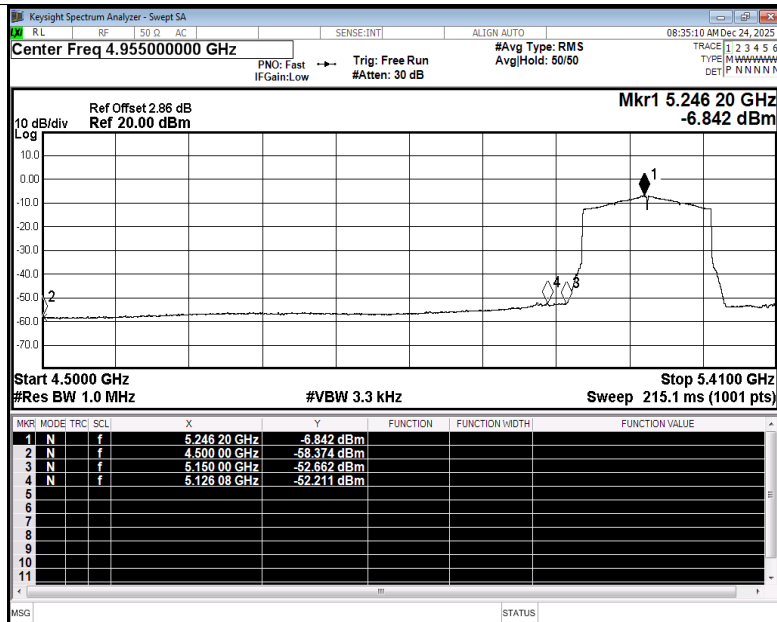

Restrict Band NVNT ax160 5250MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

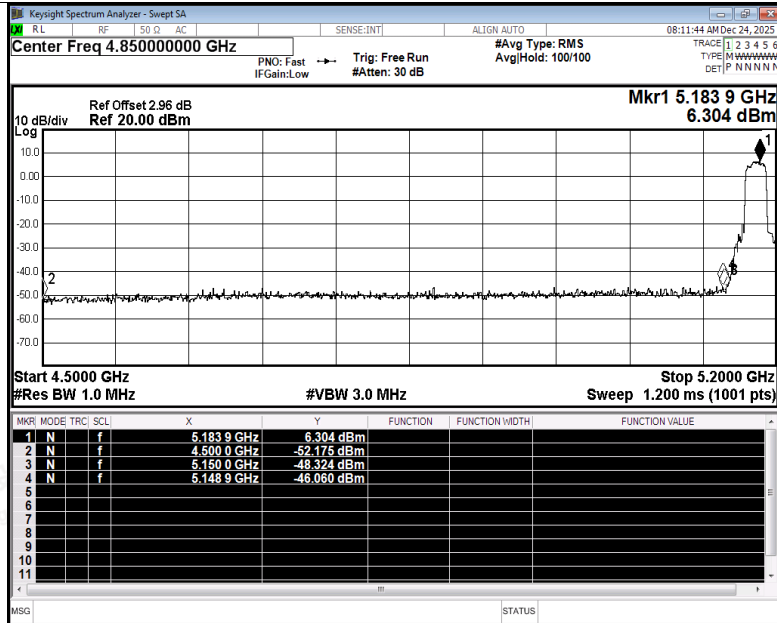


Restrict Band NVNT be20 5180MHz Ant1 Peak

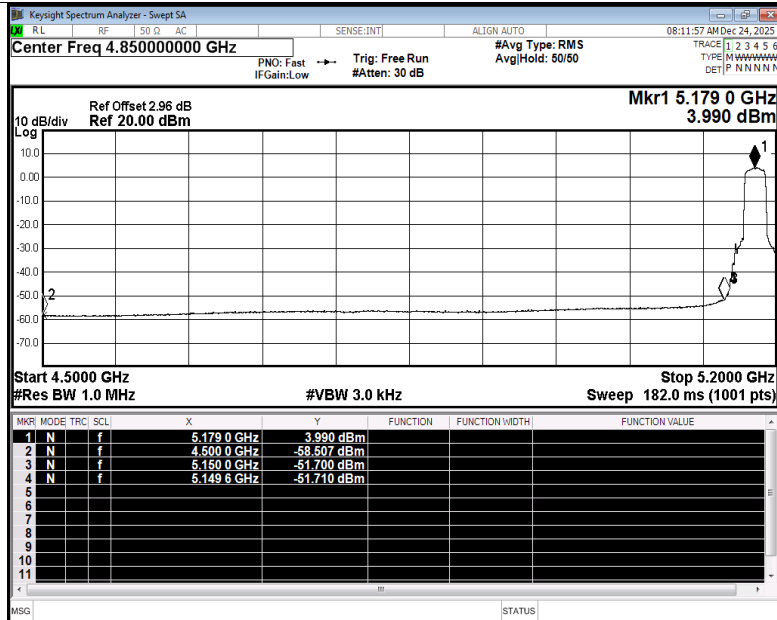


Restrict Band NVNT be20 5180MHz Ant1 Average



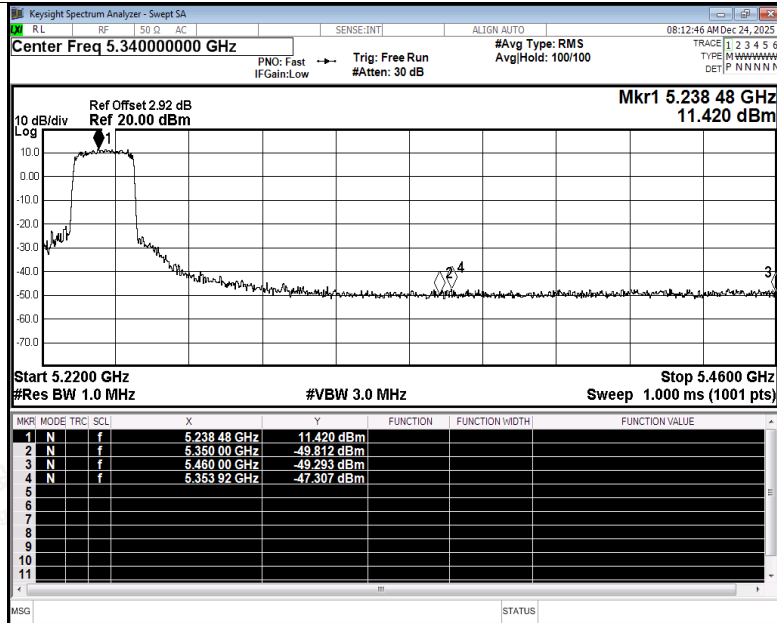


Restrict Band NVNT be20 5240MHz Ant1 Peak

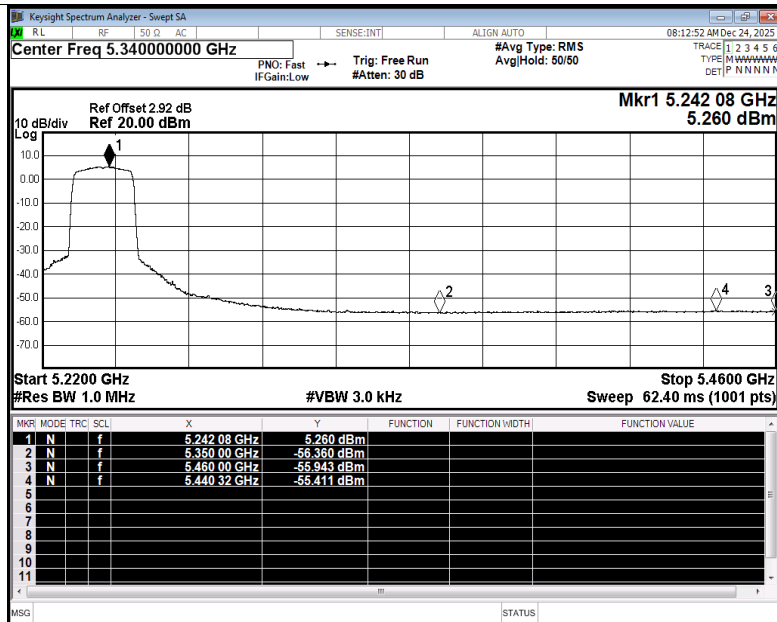


Restrict Band NVNT be20 5240MHz Ant1 Average



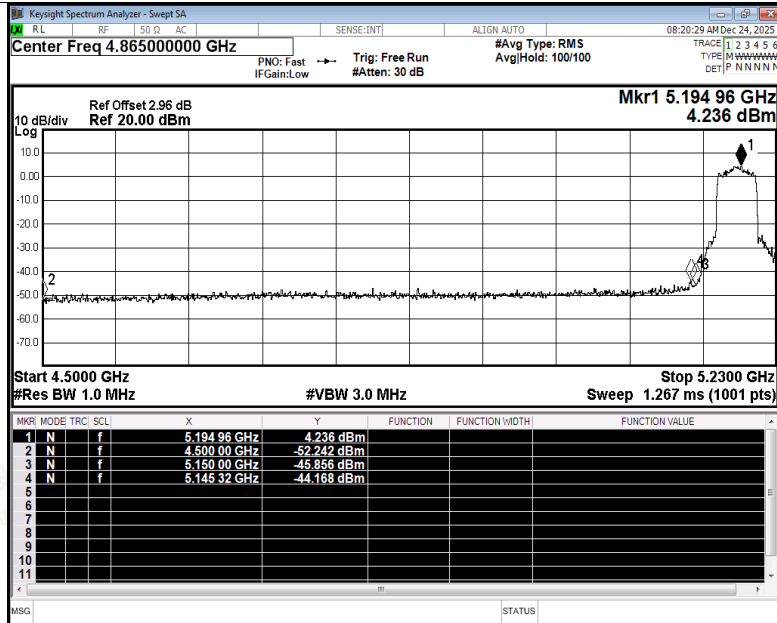

Restrict Band NVNT be40 5190MHz Ant1 Peak

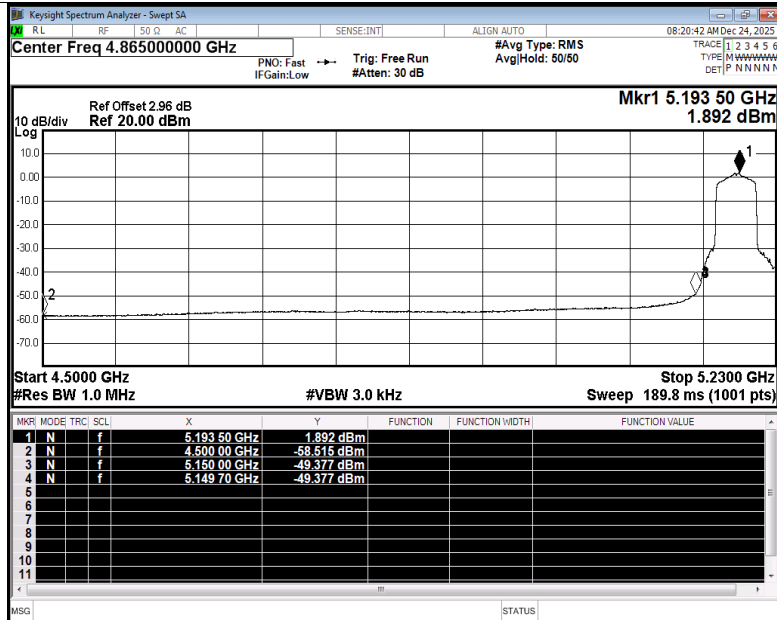

Restrict Band NVNT be40 5190MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

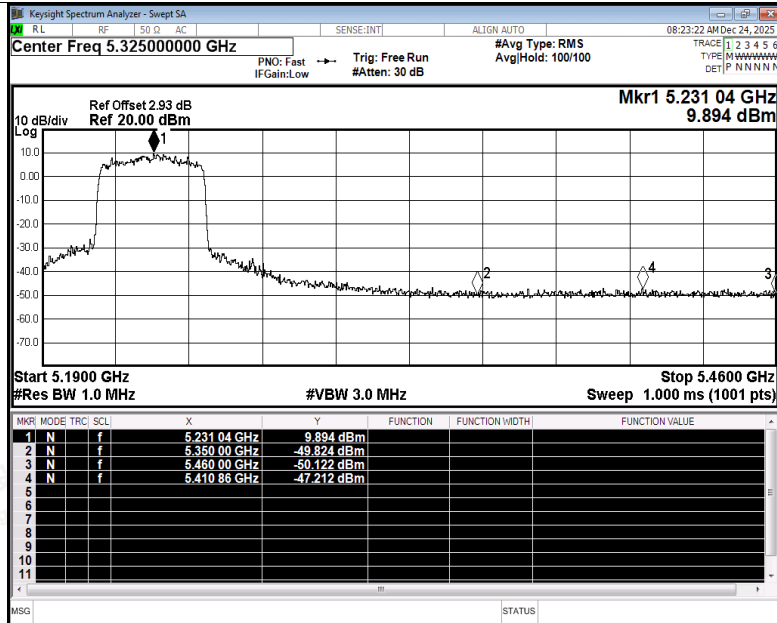

Restrict Band NVNT be40 5230MHz Ant1 Peak

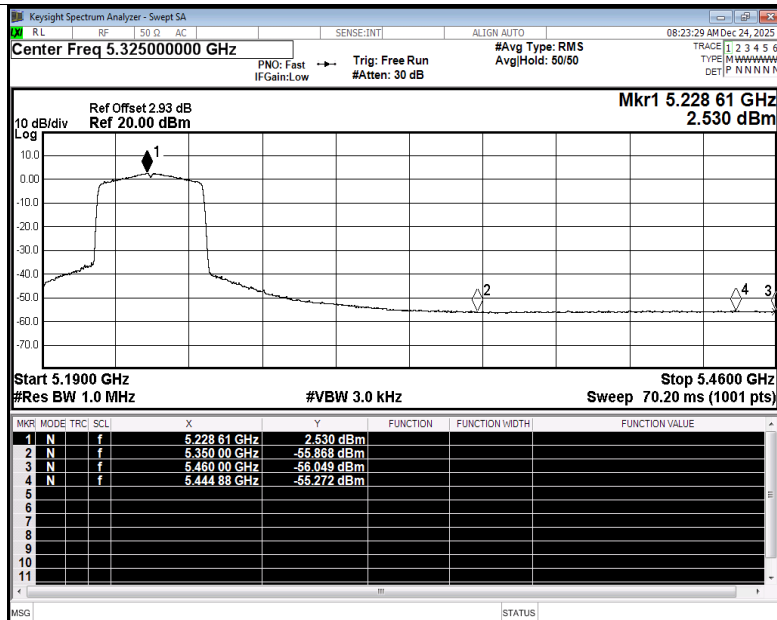

Restrict Band NVNT be40 5230MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

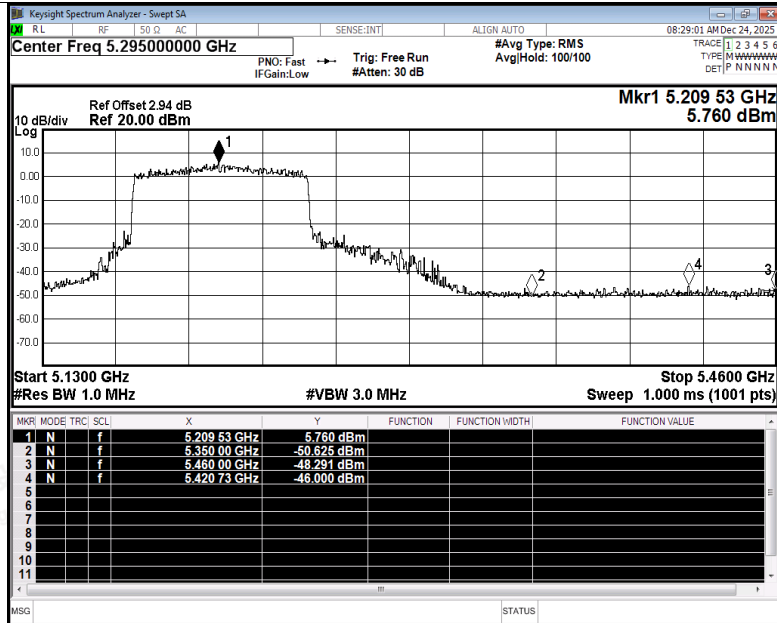

Restrict Band NVNT be80 5210MHz Ant1 Peak

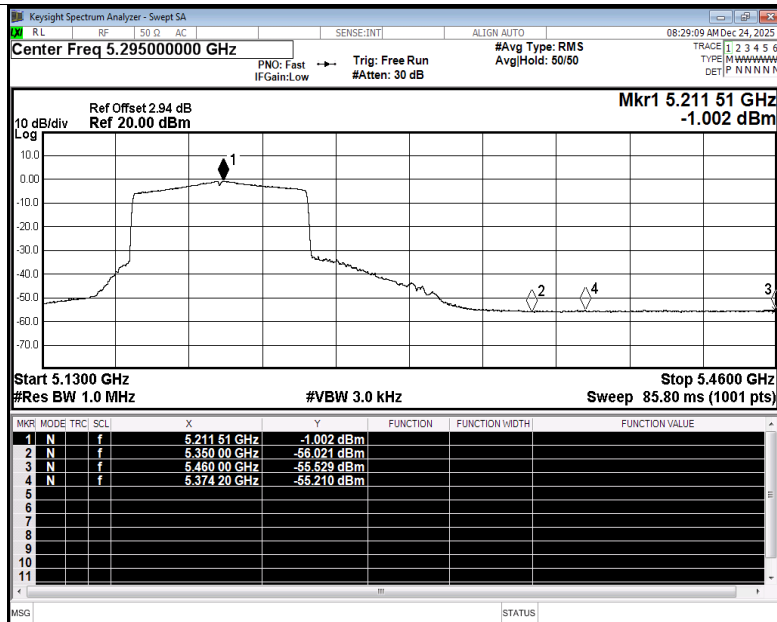

Restrict Band NVNT be80 5210MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

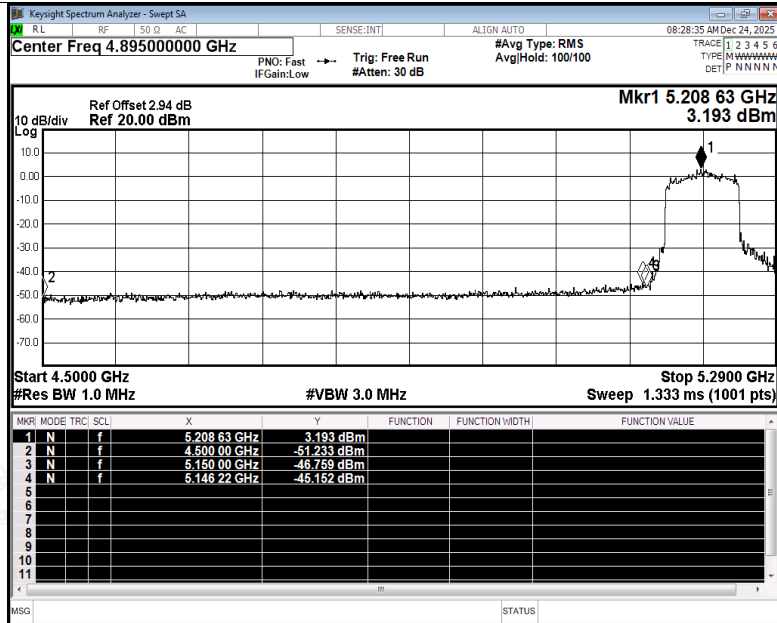

Restrict Band NVNT be80 5210MHz Ant1 Peak

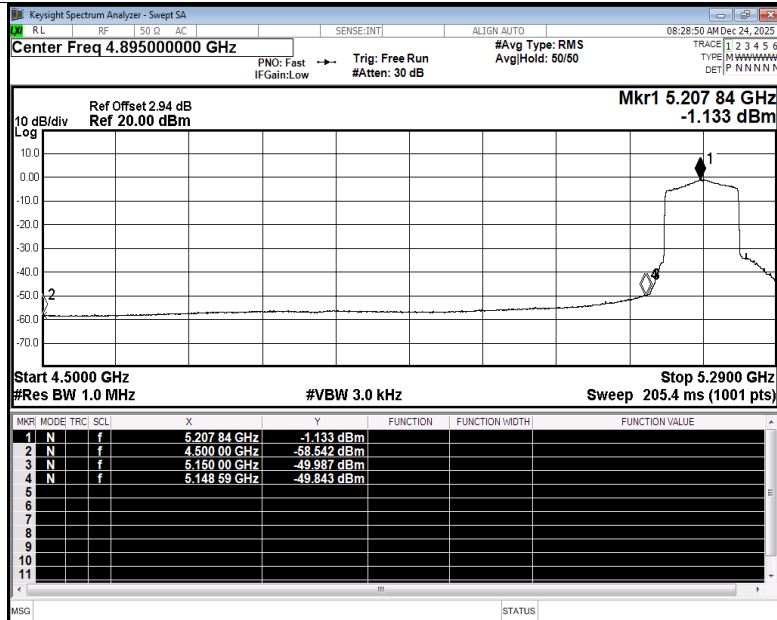

Restrict Band NVNT be80 5210MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

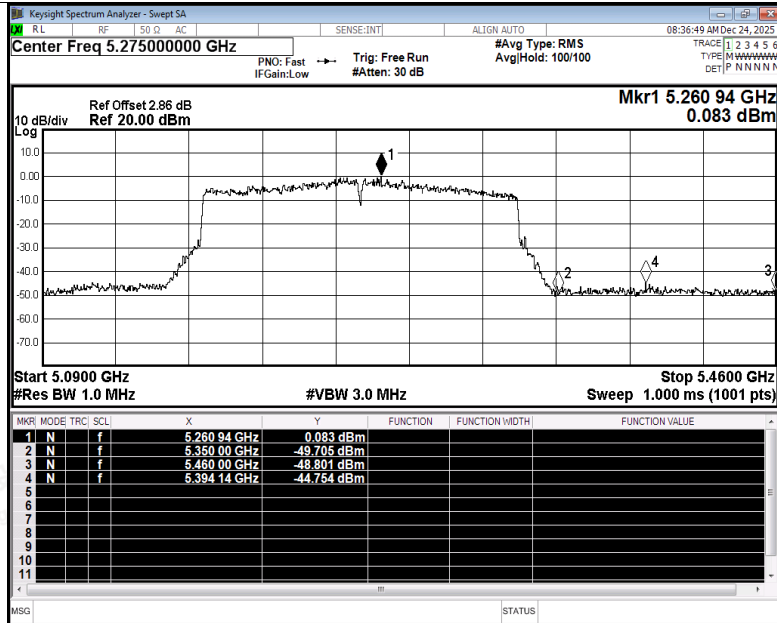

Restrict Band NVNT be160 5250MHz Ant1 Peak

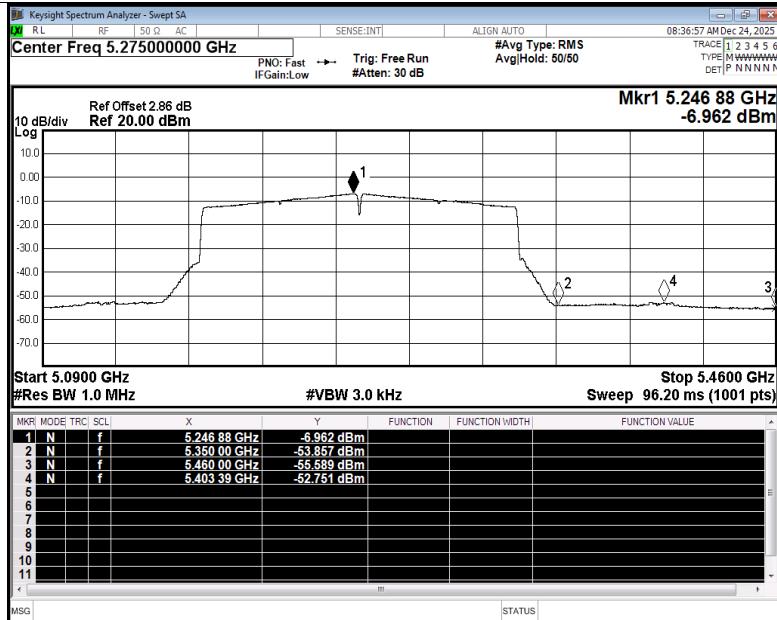

Restrict Band NVNT be160 5250MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

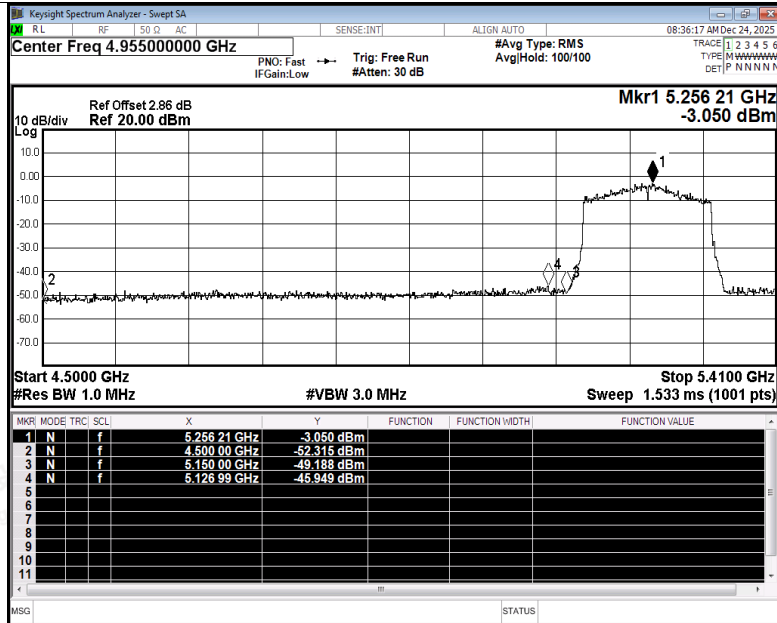

Restrict Band NVNT be160 5250MHz Ant1 Peak

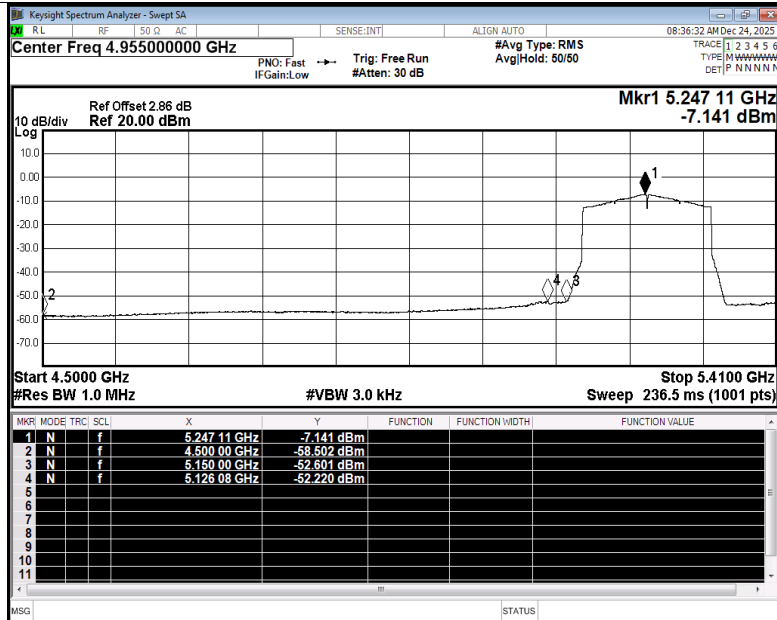

Restrict Band NVNT be160 5250MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-50.96	6.49	50.76	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-58.98	6.49	42.74	Average	54	Pass
NVNT	a	5180	Ant2	5148.9	-45.45	6.49	56.27	Peak	68.2	Pass
NVNT	a	5180	Ant2	5149.6	-53.46	6.49	48.26	Average	54	Pass
NVNT	a	5180	Ant2	5150	-49.5	6.49	52.22	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-53.16	6.49	48.56	Average	54	Pass
NVNT	a	5240	Ant2	5350	-50.54	6.49	51.18	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-57.3	6.49	44.42	Average	54	Pass
NVNT	a	5240	Ant2	5375.52	-46.59	6.49	55.13	Peak	68.2	Pass
NVNT	a	5240	Ant2	5430.96	-56.51	6.49	45.21	Average	54	Pass
NVNT	a	5240	Ant2	5460	-48.27	6.49	53.45	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-56.94	6.49	44.78	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-52.66	6.49	49.06	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-59.07	6.49	42.65	Average	54	Pass
NVNT	n20	5180	Ant2	5102	-46.12	6.49	55.6	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5148.2	-53.8	6.49	47.92	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-47.43	6.49	54.29	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-53.59	6.49	48.13	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-50.02	6.49	51.7	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-57.03	6.49	44.69	Average	54	Pass
NVNT	n20	5240	Ant2	5422.8	-47.08	6.49	54.64	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5433.36	-56.38	6.49	45.34	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-49.54	6.49	52.18	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-56.79	6.49	44.93	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-51.5	6.49	50.22	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-58.96	6.49	42.76	Average	54	Pass
NVNT	n40	5190	Ant2	5148.24	-42.66	6.49	59.06	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-49.64	6.49	52.08	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-45.05	6.49	56.67	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-49.02	6.49	52.7	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-50.81	6.49	50.91	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-56.85	6.49	44.87	Average	54	Pass
NVNT	n40	5230	Ant2	5423.82	-47.16	6.49	54.56	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5431.92	-56.65	6.49	45.07	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-50.35	6.49	51.37	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-56.93	6.49	44.79	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-53.14	6.49	48.58	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-58.99	6.49	42.73	Average	54	Pass
NVNT	ac20	5180	Ant2	5149.6	-46.19	6.49	55.53	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	5149.6	-53.54	6.49	48.18	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-48.75	6.49	52.97	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-53.13	6.49	48.59	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-48.69	6.49	53.03	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-56.83	6.49	44.89	Average	54	Pass
NVNT	ac20	5240	Ant2	5459.76	-46.78	6.49	54.94	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5446.08	-56.42	6.49	45.3	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-46.95	6.49	54.77	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-56.76	6.49	44.96	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-51.49	6.49	50.23	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-58.8	6.49	42.92	Average	54	Pass
NVNT	ac40	5190	Ant2	5135.83	-44.52	6.49	57.2	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5149.7	-49.99	6.49	51.73	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-45.73	6.49	55.99	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-49.44	6.49	52.28	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-50.29	6.49	51.43	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-56.53	6.49	45.19	Average	54	Pass
NVNT	ac40	5230	Ant2	5421.66	-46.84	6.49	54.88	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5438.94	-56.32	6.49	45.4	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-49.63	6.49	52.09	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-56.63	6.49	45.09	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-48.79	6.49	52.93	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-56.22	6.49	45.5	Average	54	Pass
NVNT	ac80	5210	Ant2	5444.16	-45.84	6.49	55.88	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5435.58	-55.99	6.49	45.73	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-49.75	6.49	51.97	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-56.29	6.49	45.43	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-52.09	6.49	49.63	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-58.74	6.49	42.98	Average	54	Pass
NVNT	ac80	5210	Ant2	5139.9	-44.48	6.49	57.24	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5147.01	-50.17	6.49	51.55	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-42.68	6.49	59.04	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-50.34	6.49	51.38	Average	54	Pass
NVNT	ac160	5250	Ant2	5350	-47.03	6.49	54.69	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5350	-51.64	6.49	50.08	Average	54	Pass
NVNT	ac160	5250	Ant2	5366.39	-42.83	6.49	58.89	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5397.47	-48.77	6.49	52.95	Average	54	Pass
NVNT	ac160	5250	Ant2	5460	-49.63	6.49	52.09	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5460	-55.84	6.49	45.88	Average	54	Pass
NVNT	ac160	5250	Ant2	4500	-52.35	6.49	49.37	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	4500	-58.65	6.49	43.07	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac160	5250	Ant2	5126.08	-45.31	6.49	56.41	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5119.71	-51.75	6.49	49.97	Average	54	Pass
NVNT	ac160	5250	Ant2	5150	-49.59	6.49	52.13	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5150	-53.12	6.49	48.6	Average	54	Pass
NVNT	ax20	5180	Ant2	4500	-51.81	6.49	49.91	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-58.82	6.49	42.9	Average	54	Pass
NVNT	ax20	5180	Ant2	5010.3	-46.32	6.49	55.4	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5149.6	-51.82	6.49	49.9	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-47.57	6.49	54.15	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5150	-51.24	6.49	50.48	Average	54	Pass
NVNT	ax20	5240	Ant2	5350	-50.45	6.49	51.27	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5350	-56.75	6.49	44.97	Average	54	Pass
NVNT	ax20	5240	Ant2	5432.64	-46.92	6.49	54.8	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5442.48	-56.25	6.49	45.47	Average	54	Pass
NVNT	ax20	5240	Ant2	5460	-49.12	6.49	52.6	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5460	-56.49	6.49	45.23	Average	54	Pass
NVNT	ax40	5190	Ant2	4500	-50.97	6.49	50.75	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-58.76	6.49	42.96	Average	54	Pass
NVNT	ax40	5190	Ant2	5145.32	-45.62	6.49	56.1	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5149.7	-49.64	6.49	52.08	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-44.81	6.49	56.91	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-48.84	6.49	52.88	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-51.06	6.49	50.66	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-56.55	6.49	45.17	Average	54	Pass
NVNT	ax40	5230	Ant2	5434.62	-45.73	6.49	55.99	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5352.27	-56.19	6.49	45.53	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-48.84	6.49	52.88	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-56.59	6.49	45.13	Average	54	Pass
NVNT	ax80	5210	Ant2	5350	-50.4	6.49	51.32	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350	-56.08	6.49	45.64	Average	54	Pass
NVNT	ax80	5210	Ant2	5387.73	-46.59	6.49	55.13	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5422.38	-55.69	6.49	46.03	Average	54	Pass
NVNT	ax80	5210	Ant2	5460	-49.75	6.49	51.97	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5460	-56.35	6.49	45.37	Average	54	Pass
NVNT	ax80	5210	Ant2	4500	-51.83	6.49	49.89	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-58.78	6.49	42.94	Average	54	Pass
NVNT	ax80	5210	Ant2	5124.1	-44.85	6.49	56.87	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5148.59	-49.62	6.49	52.1	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-44.16	6.49	57.56	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-49.7	6.49	52.02	Average	54	Pass
NVNT	ax160	5250	Ant2	5350	-46.99	6.49	54.73	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax160	5250	Ant2	5350	-51.25	6.49	50.47	Average	54	Pass
NVNT	ax160	5250	Ant2	5358.25	-42.73	6.49	58.99	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5393.77	-49.6	6.49	52.12	Average	54	Pass
NVNT	ax160	5250	Ant2	5460	-47.58	6.49	54.14	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5460	-55.51	6.49	46.21	Average	54	Pass
NVNT	ax160	5250	Ant2	4500	-52.38	6.49	49.34	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	4500	-58.33	6.49	43.39	Average	54	Pass
NVNT	ax160	5250	Ant2	5128.81	-45.74	6.49	55.98	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5134.27	-50.89	6.49	50.83	Average	54	Pass
NVNT	ax160	5250	Ant2	5150	-46.81	6.49	54.91	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5150	-51.6	6.49	50.12	Average	54	Pass
NVNT	be20	5180	Ant2	4500	-50.45	6.49	51.27	Peak	68.2	Pass
NVNT	be20	5180	Ant2	4500	-58.57	6.49	43.15	Average	54	Pass
NVNT	be20	5180	Ant2	5148.9	-46.03	6.49	55.69	Peak	68.2	Pass
NVNT	be20	5180	Ant2	5149.6	-51.45	6.49	50.27	Average	54	Pass
NVNT	be20	5180	Ant2	5150	-47.47	6.49	54.25	Peak	68.2	Pass
NVNT	be20	5180	Ant2	5150	-51.18	6.49	50.54	Average	54	Pass
NVNT	be20	5240	Ant2	5350	-50.6	6.49	51.12	Peak	68.2	Pass
NVNT	be20	5240	Ant2	5350	-56.36	6.49	45.36	Average	54	Pass
NVNT	be20	5240	Ant2	5438.4	-46.42	6.49	55.3	Peak	68.2	Pass
NVNT	be20	5240	Ant2	5421.84	-55.73	6.49	45.99	Average	54	Pass
NVNT	be20	5240	Ant2	5460	-50.31	6.49	51.41	Peak	68.2	Pass
NVNT	be20	5240	Ant2	5460	-55.77	6.49	45.95	Average	54	Pass
NVNT	be40	5190	Ant2	4500	-50.54	6.49	51.18	Peak	68.2	Pass
NVNT	be40	5190	Ant2	4500	-58.77	6.49	42.95	Average	54	Pass
NVNT	be40	5190	Ant2	5097.87	-46.36	6.49	55.36	Peak	68.2	Pass
NVNT	be40	5190	Ant2	5149.7	-50.27	6.49	51.45	Average	54	Pass
NVNT	be40	5190	Ant2	5150	-45.73	6.49	55.99	Peak	68.2	Pass
NVNT	be40	5190	Ant2	5150	-49.53	6.49	52.19	Average	54	Pass
NVNT	be40	5230	Ant2	5350	-49.58	6.49	52.14	Peak	68.2	Pass
NVNT	be40	5230	Ant2	5350	-56.51	6.49	45.21	Average	54	Pass
NVNT	be40	5230	Ant2	5405.46	-47.15	6.49	54.57	Peak	68.2	Pass
NVNT	be40	5230	Ant2	5421.39	-56.1	6.49	45.62	Average	54	Pass
NVNT	be40	5230	Ant2	5460	-50.43	6.49	51.29	Peak	68.2	Pass
NVNT	be40	5230	Ant2	5460	-56.63	6.49	45.09	Average	54	Pass
NVNT	be80	5210	Ant2	5350	-49.59	6.49	52.13	Peak	68.2	Pass
NVNT	be80	5210	Ant2	5350	-55.87	6.49	45.85	Average	54	Pass
NVNT	be80	5210	Ant2	5387.07	-46.03	6.49	55.69	Peak	68.2	Pass
NVNT	be80	5210	Ant2	5442.18	-55.79	6.49	45.93	Average	54	Pass
NVNT	be80	5210	Ant2	5460	-48.96	6.49	52.76	Peak	68.2	Pass
NVNT	be80	5210	Ant2	5460	-56.14	6.49	45.58	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	be80	5210	Ant2	4500	-51.17	6.49	50.55	Peak	68.2	Pass
NVNT	be80	5210	Ant2	4500	-58.68	6.49	43.04	Average	54	Pass
NVNT	be80	5210	Ant2	5124.89	-45.24	6.49	56.48	Peak	68.2	Pass
NVNT	be80	5210	Ant2	5144.64	-49.26	6.49	52.46	Average	54	Pass
NVNT	be80	5210	Ant2	5150	-45.37	6.49	56.35	Peak	68.2	Pass
NVNT	be80	5210	Ant2	5150	-47.86	6.49	53.86	Average	54	Pass
NVNT	be160	5250	Ant2	5350	-47.09	6.49	54.63	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5350	-50.93	6.49	50.79	Average	54	Pass
NVNT	be160	5250	Ant2	5396.73	-42.11	6.49	59.61	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5396.73	-49.44	6.49	52.28	Average	54	Pass
NVNT	be160	5250	Ant2	5460	-49.19	6.49	52.53	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5460	-55.56	6.49	46.16	Average	54	Pass
NVNT	be160	5250	Ant2	4500	-52.35	6.49	49.37	Peak	68.2	Pass
NVNT	be160	5250	Ant2	4500	-58.62	6.49	43.1	Average	54	Pass
NVNT	be160	5250	Ant2	5129.72	-45.28	6.49	56.44	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5134.27	-50.83	6.49	50.89	Average	54	Pass
NVNT	be160	5250	Ant2	5150	-47.24	6.49	54.48	Peak	68.2	Pass
NVNT	be160	5250	Ant2	5150	-51.55	6.49	50.17	Average	54	Pass



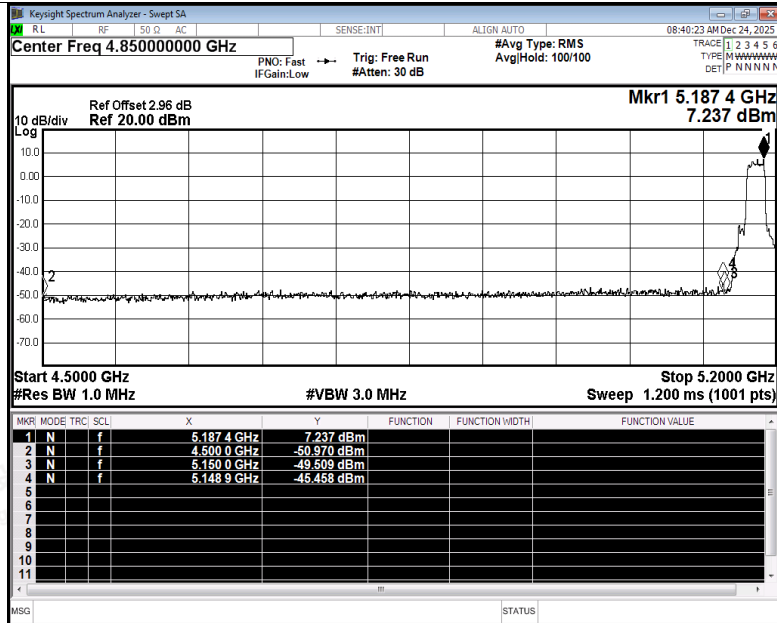

Restrict Band NVNT a 5180MHz Ant 2 Peak

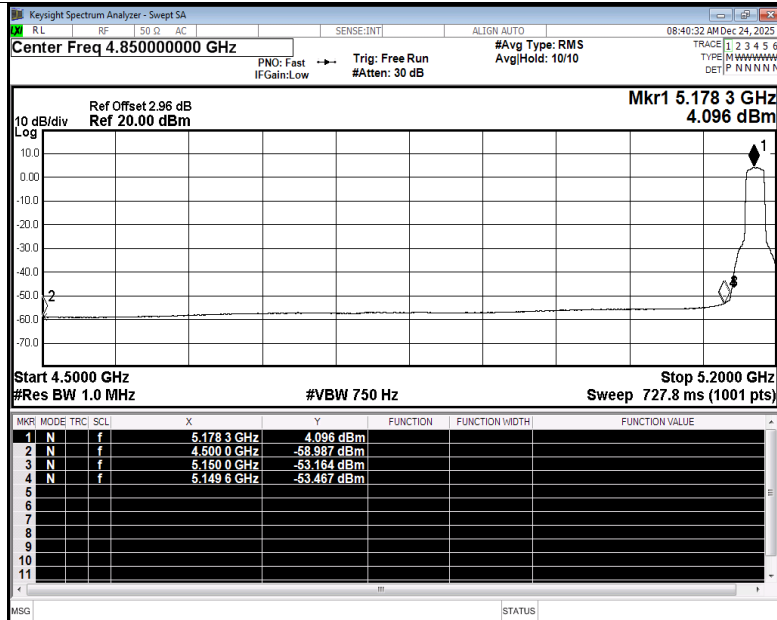

Restrict Band NVNT a 5180MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

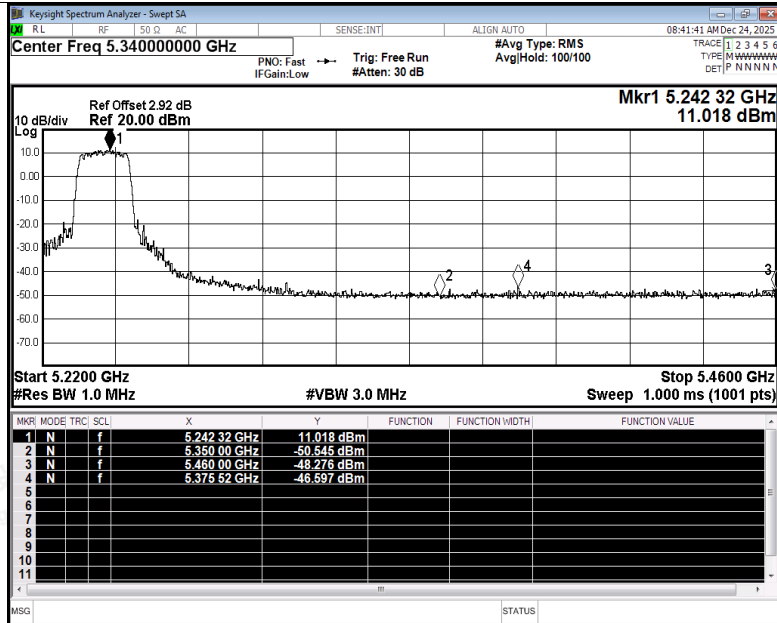


Restrict Band NVNT a 5240MHz Ant 2 Peak

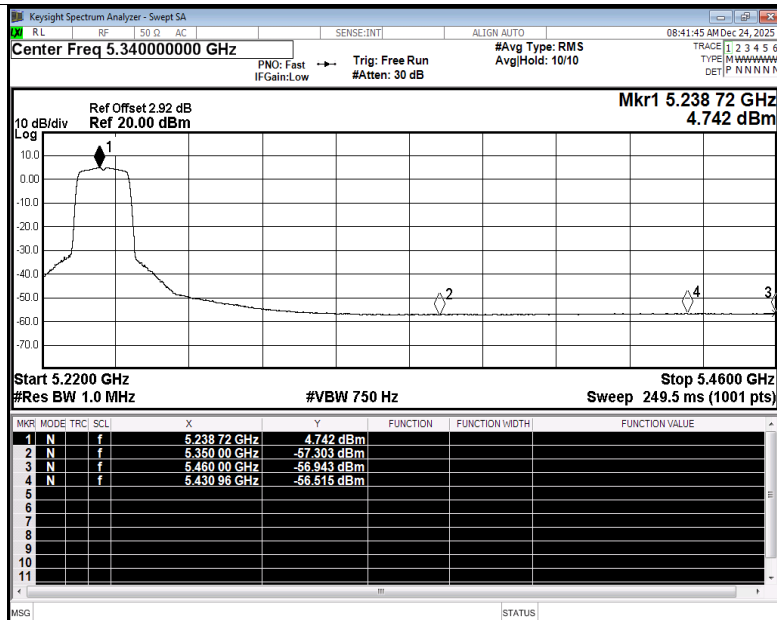


Restrict Band NVNT a 5240MHz Ant 2 Average



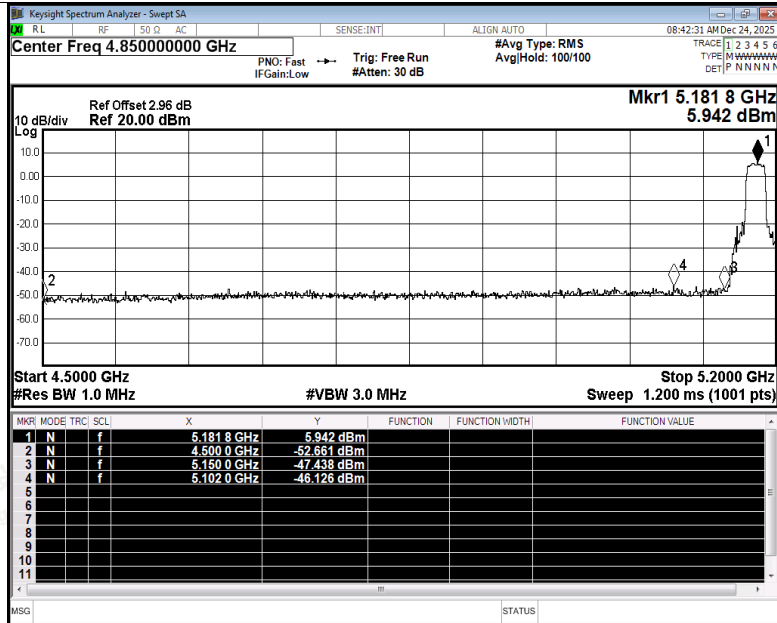


Restrict Band NVNT n20 5180MHz Ant 2 Peak

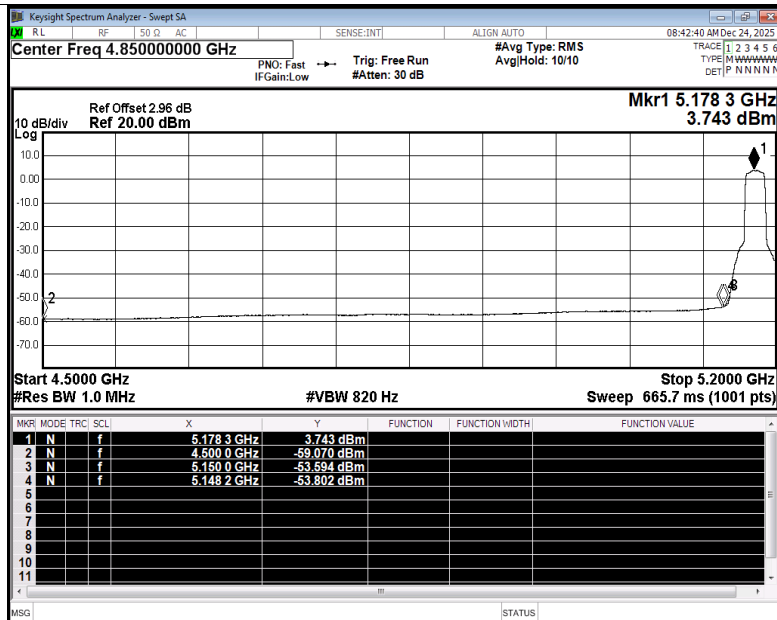


Restrict Band NVNT n20 5180MHz Ant 2 Average



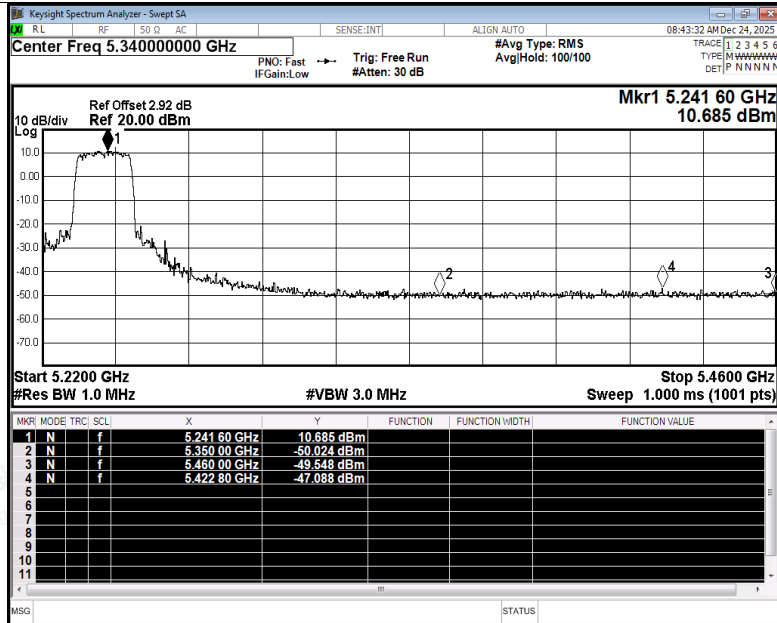


Restrict Band NVNT n20 5240MHz Ant 2 Peak

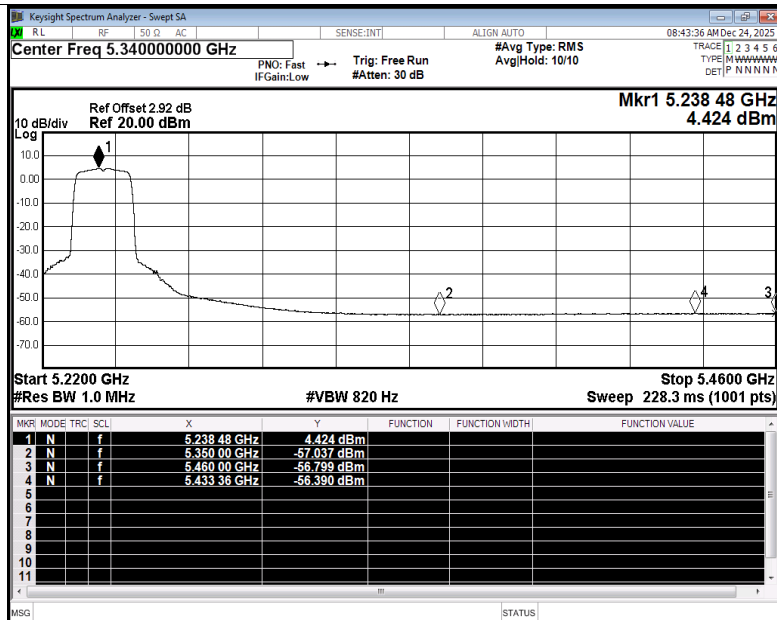


Restrict Band NVNT n20 5240MHz Ant 2 Average



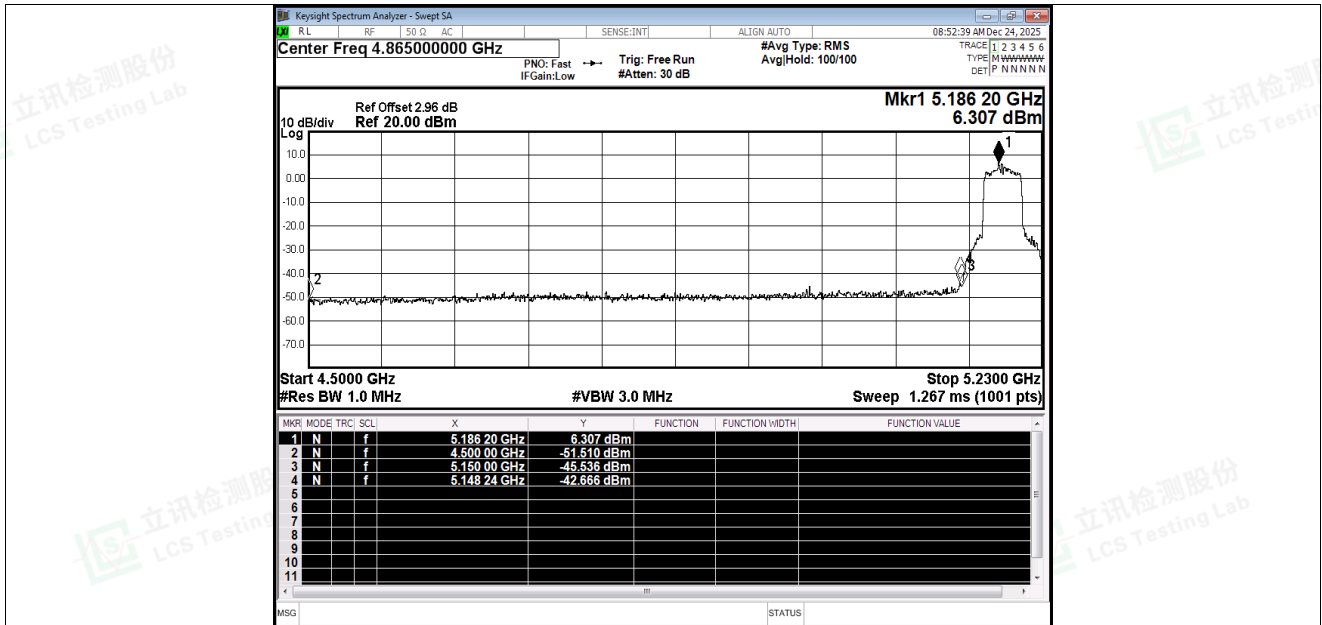


Restrict Band NVNT n40 5190MHz Ant 2 Peak

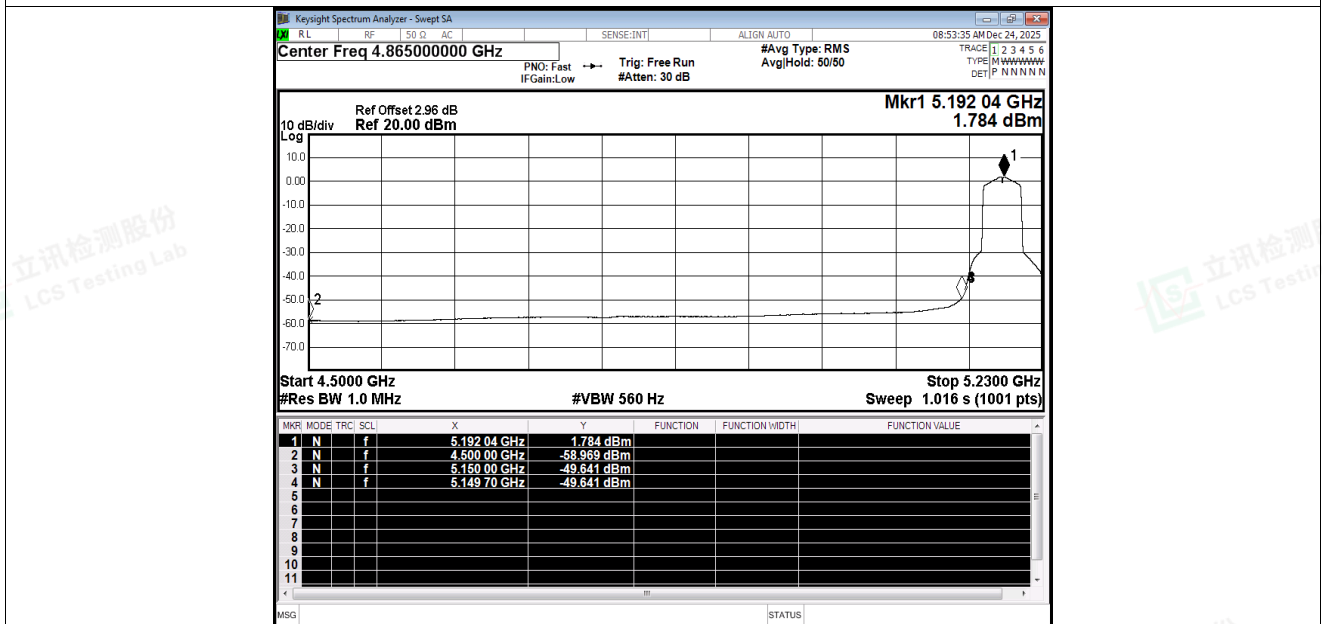


Restrict Band NVNT n40 5190MHz Ant 2 Average



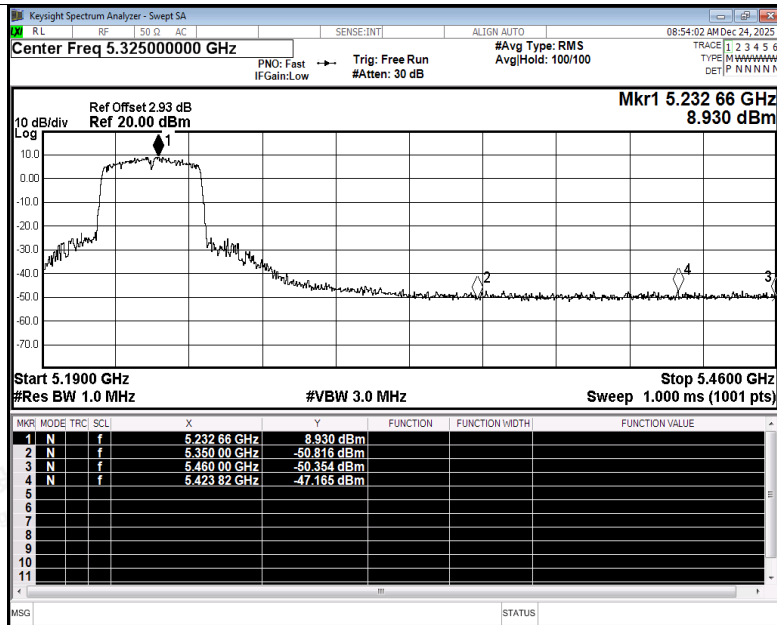


Restrict Band NVNT n40 5230MHz Ant 2 Peak

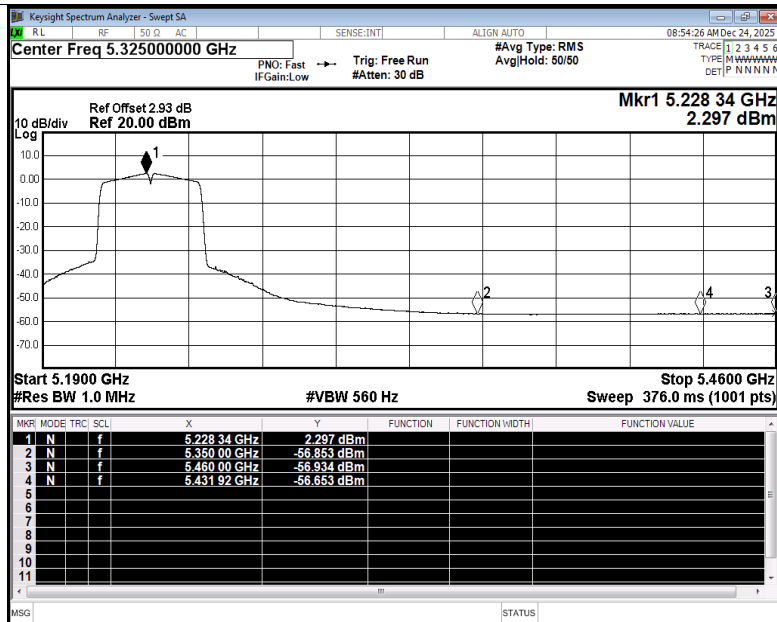


Restrict Band NVNT n40 5230MHz Ant 2 Average



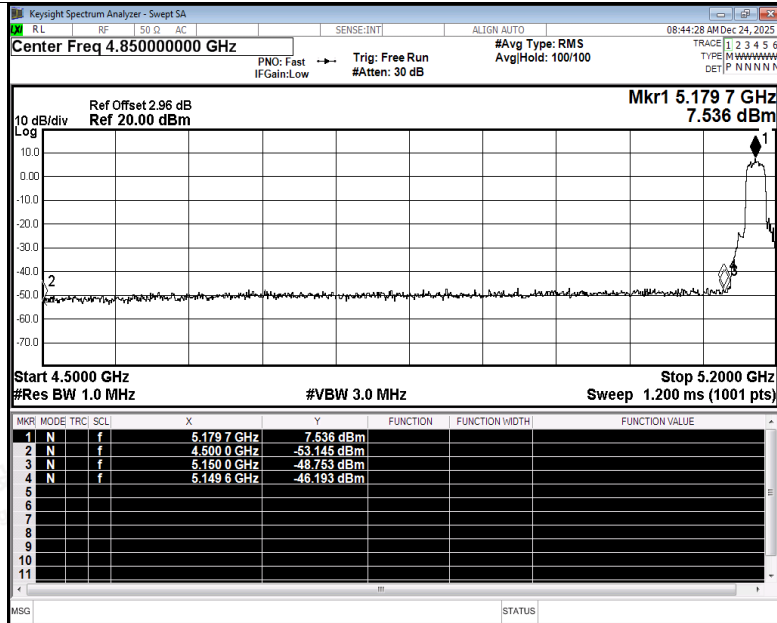


Restrict Band NVNT ac20 5180MHz Ant 2 Peak

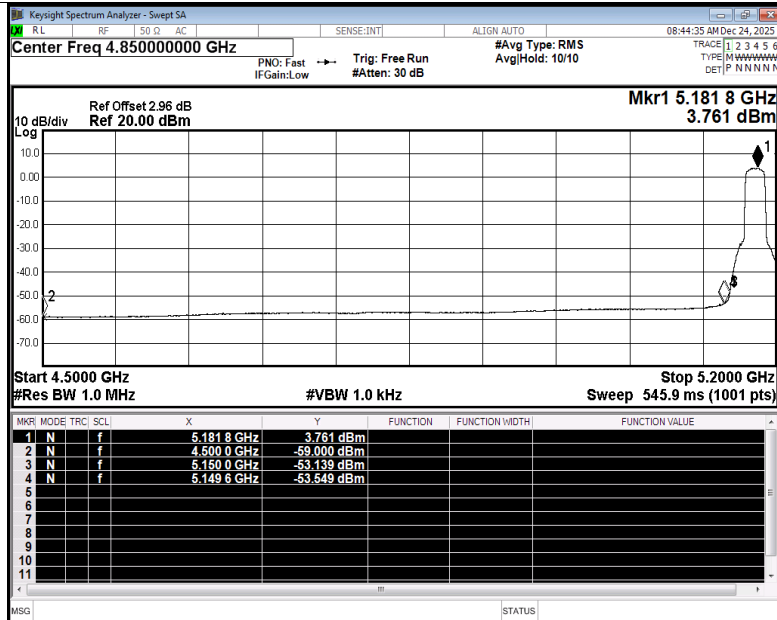


Restrict Band NVNT ac20 5180MHz Ant 2 Average



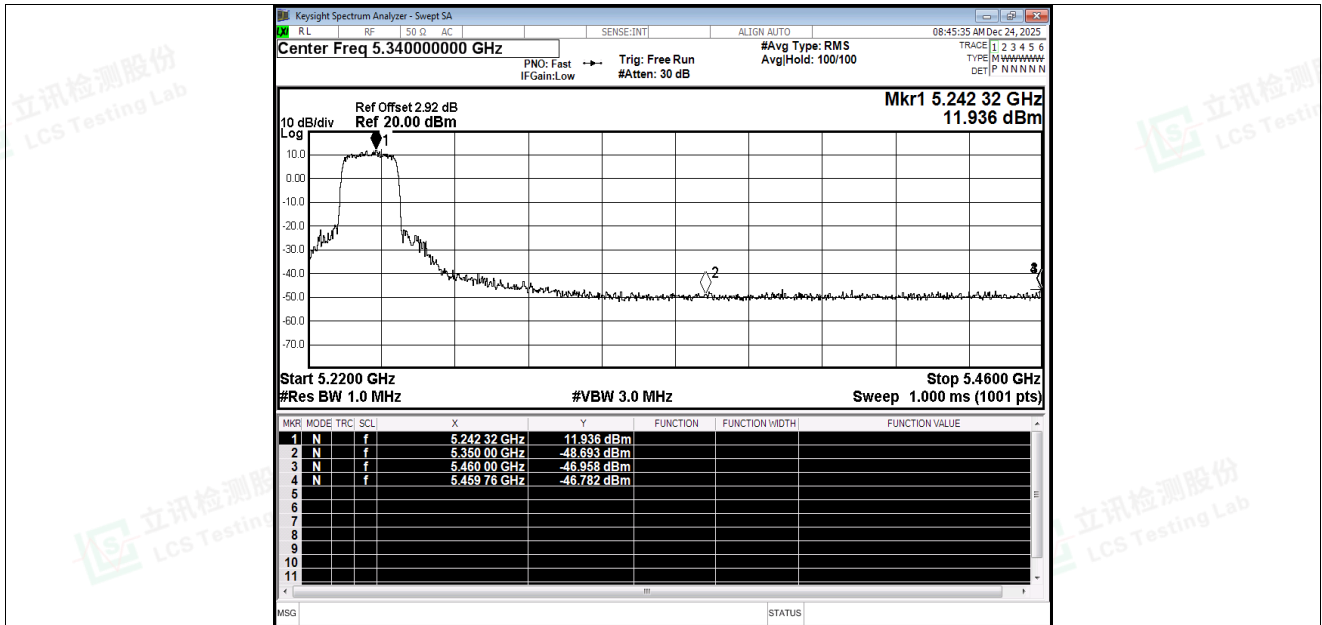


Restrict Band NVNT ac20 5240MHz Ant 2 Peak

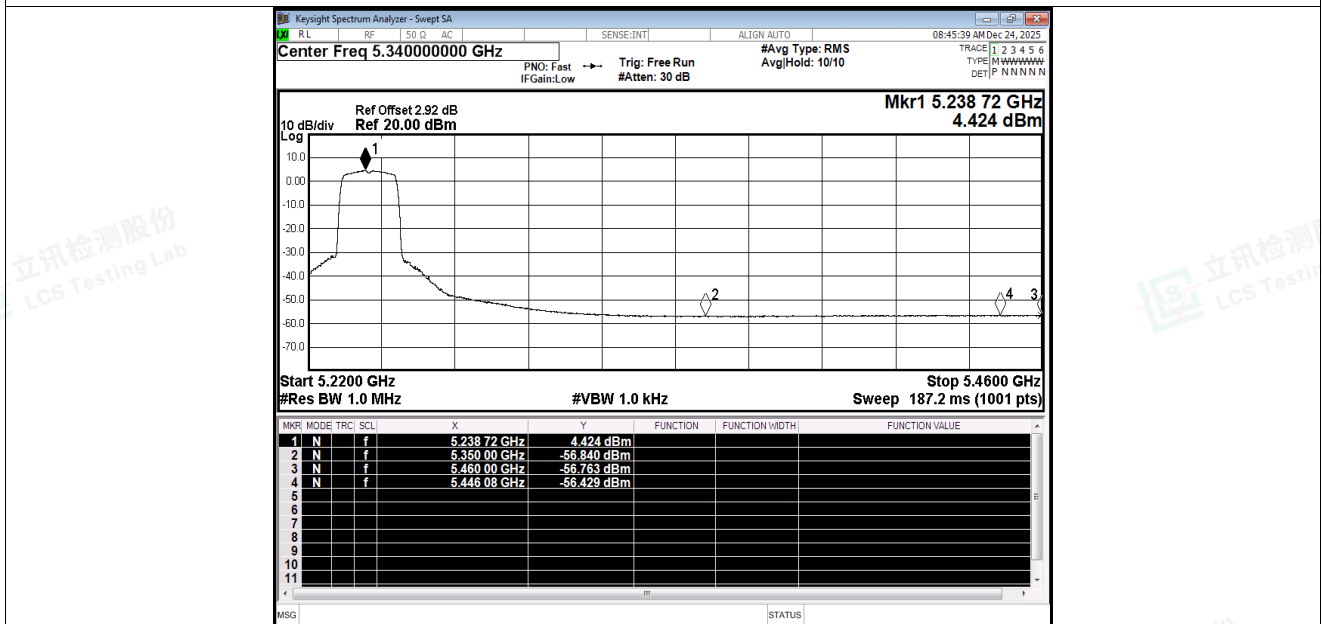


Restrict Band NVNT ac20 5240MHz Ant 2 Average



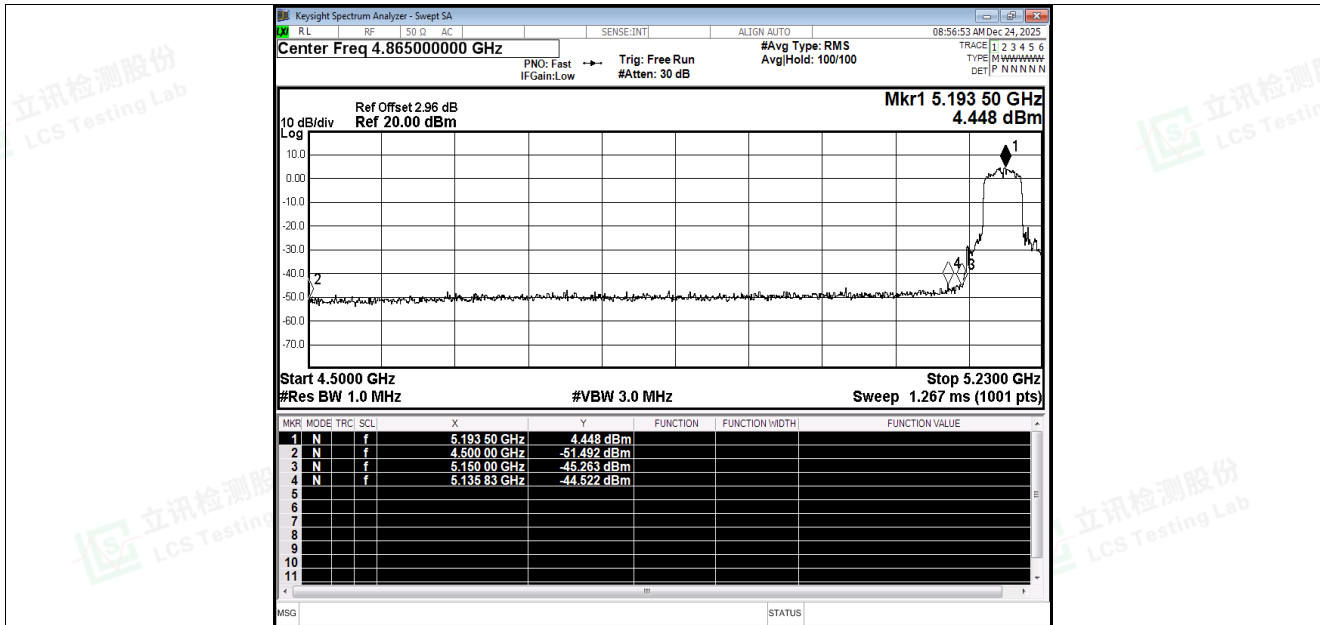


Restrict Band NVNT ac40 5190MHz Ant 2 Peak

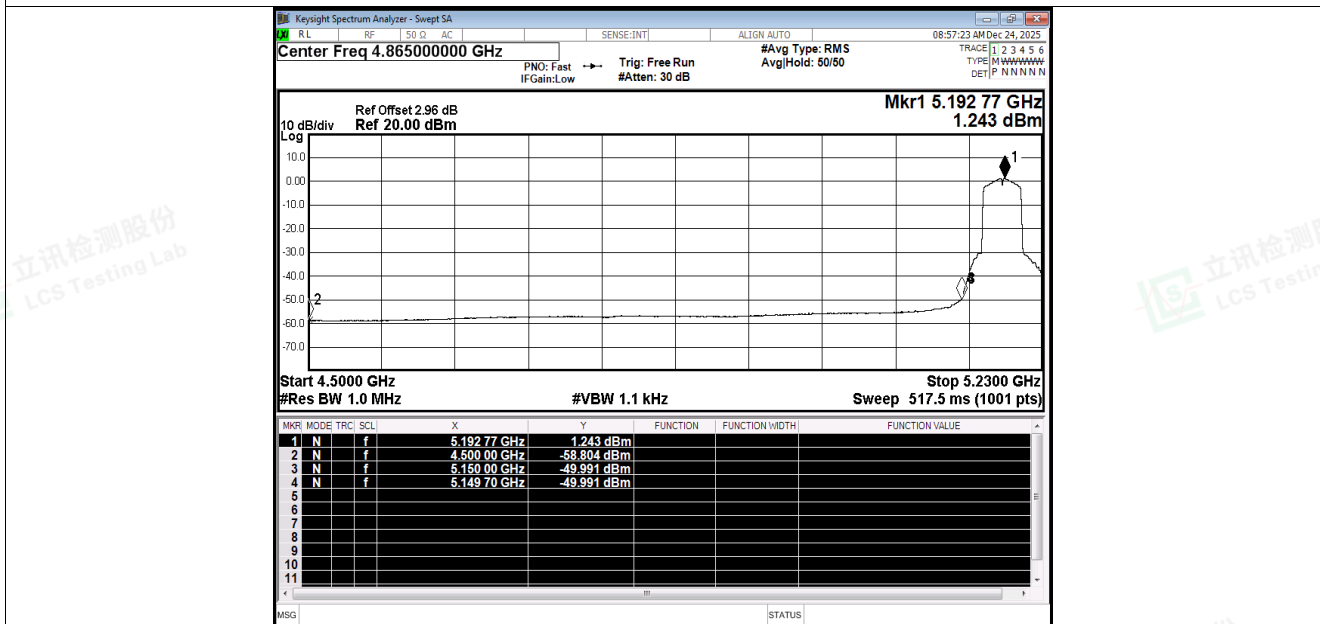


Restrict Band NVNT ac40 5190MHz Ant 2 Average



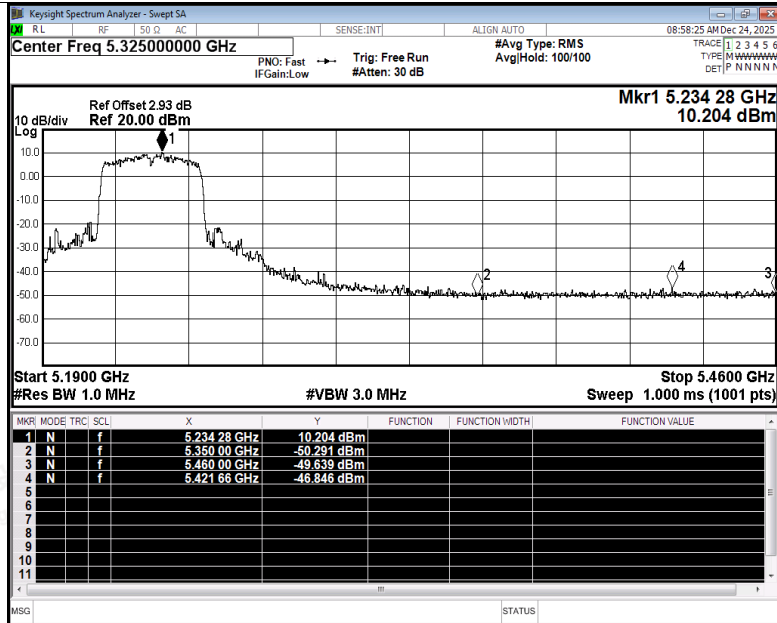

Restrict Band NVNT ac40 5230MHz Ant 2 Peak

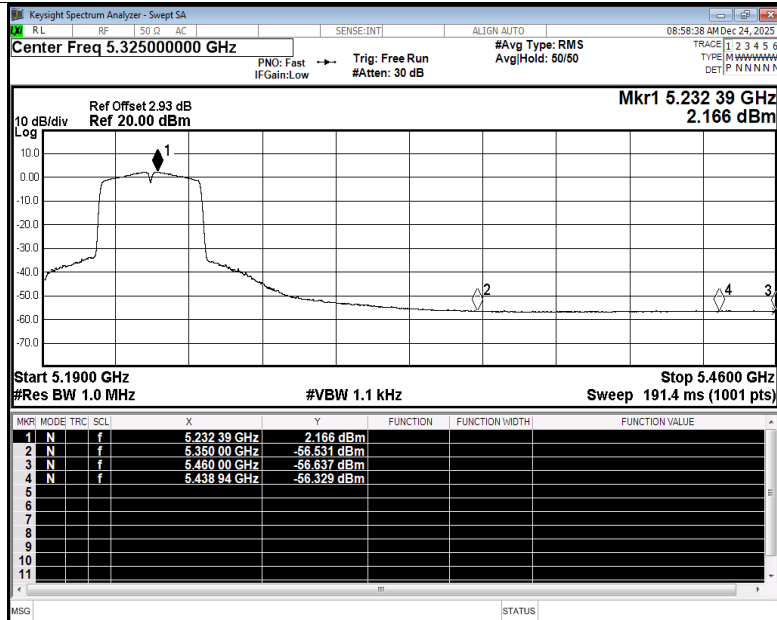

Restrict Band NVNT ac40 5230MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

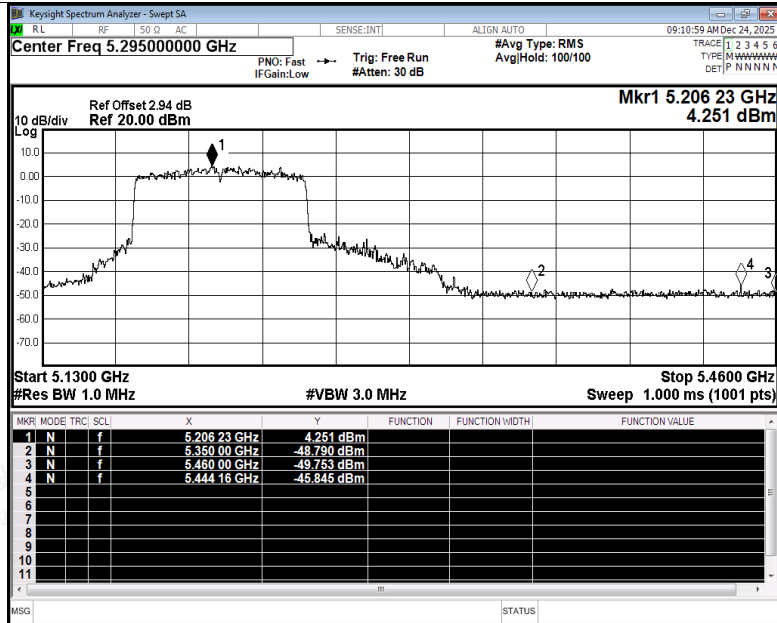

Restrict Band NVNT ac80 5210MHz Ant 2 Peak

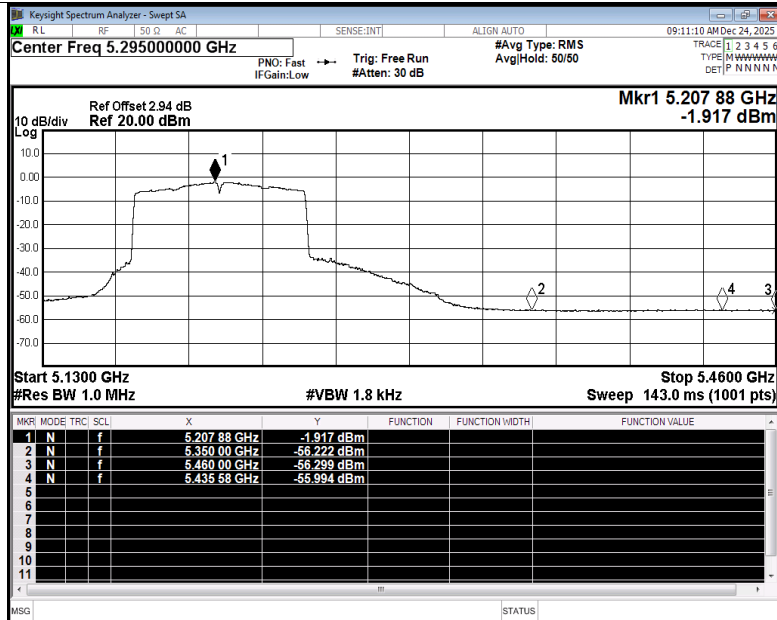

Restrict Band NVNT ac80 5210MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

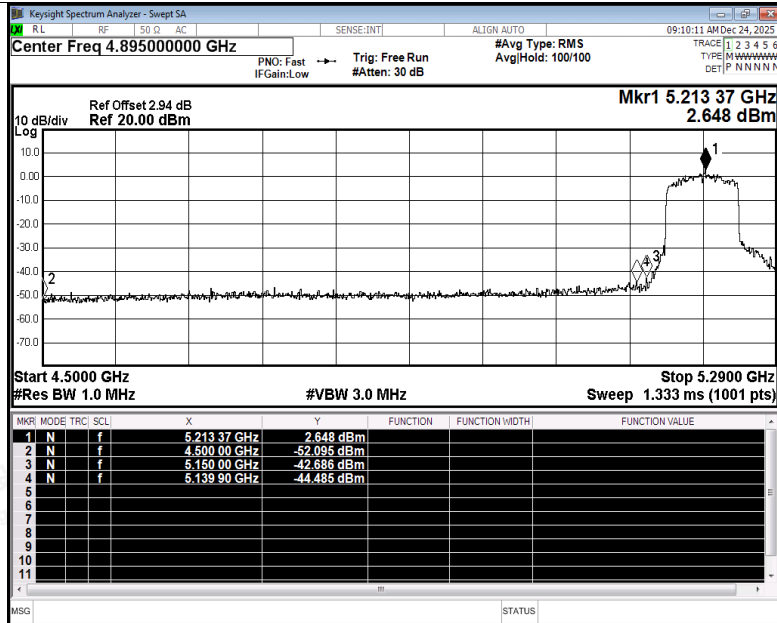

Restrict Band NVNT ac80 5210MHz Ant 2 Peak

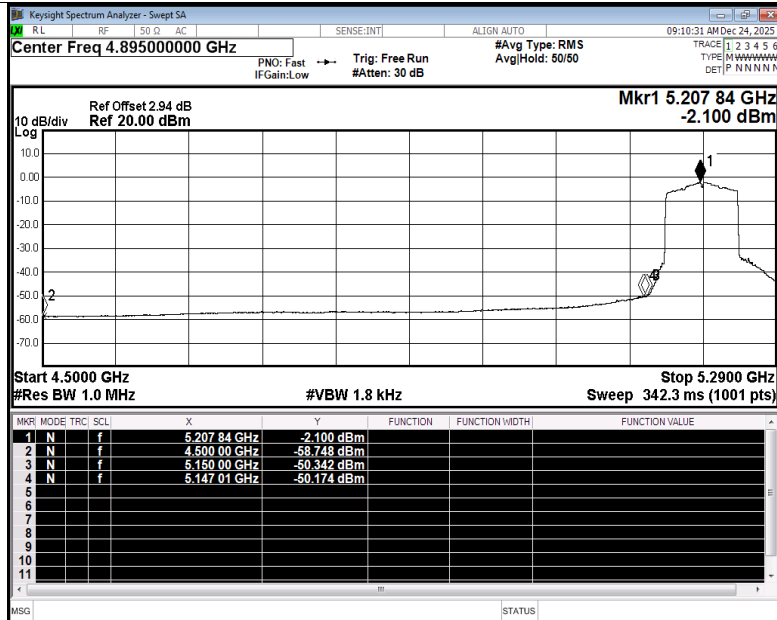

Restrict Band NVNT ac80 5210MHz Ant 2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity