





Restrict Band NVNT ac160 5250MHz Ant 2 Peak

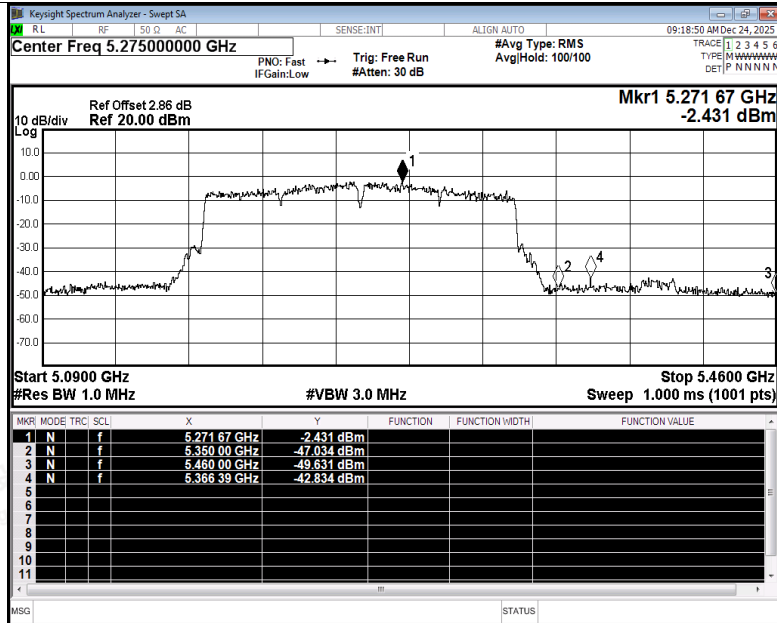

Restrict Band NVNT ac160 5250MHz Ant 2 Average

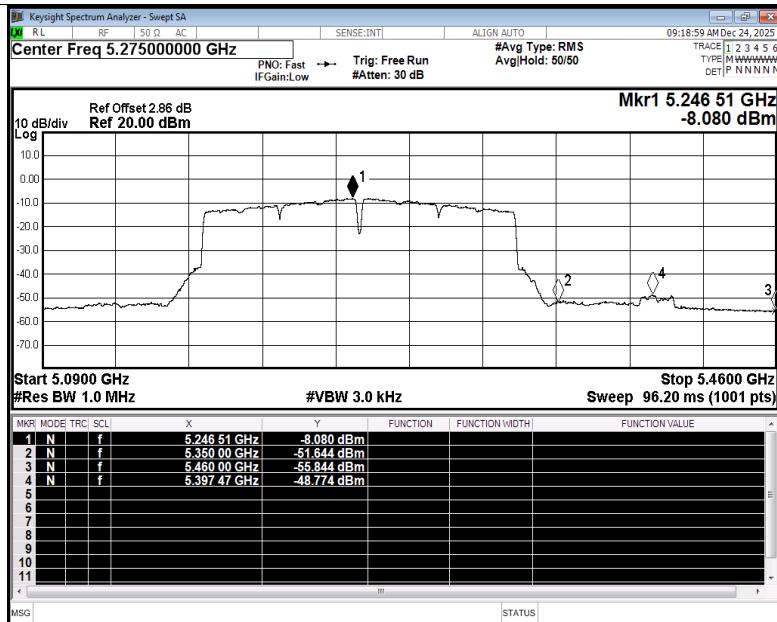


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

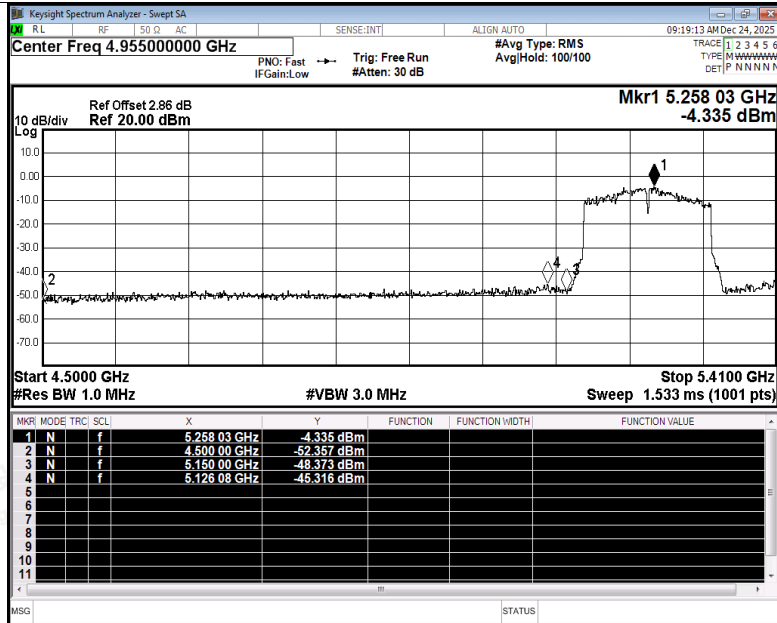

Restrict Band NVNT ac160 5250MHz Ant 2 Peak

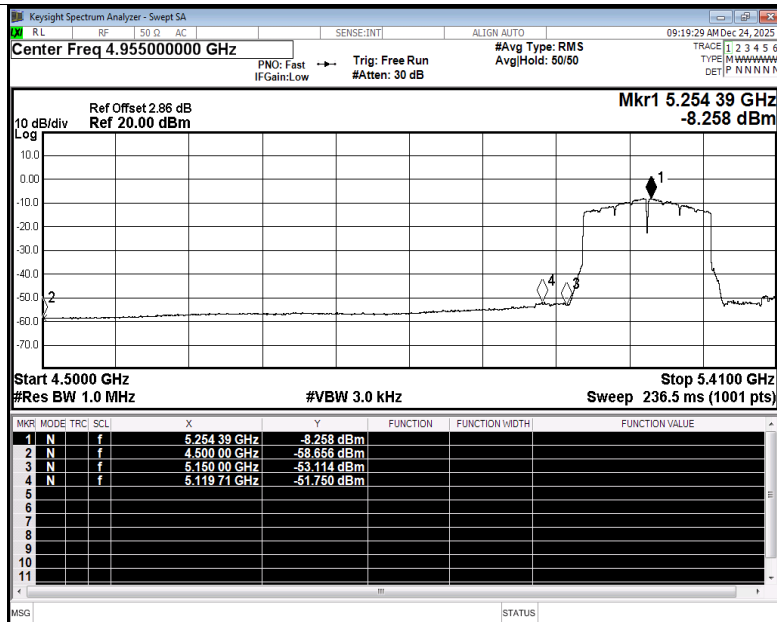

Restrict Band NVNT ac160 5250MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

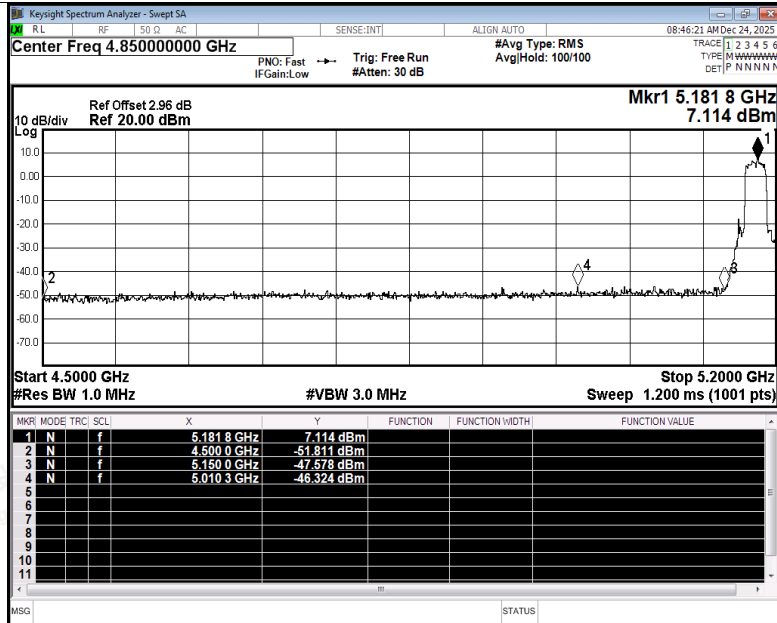

Restrict Band NVNT ax20 5180MHz Ant 2 Peak

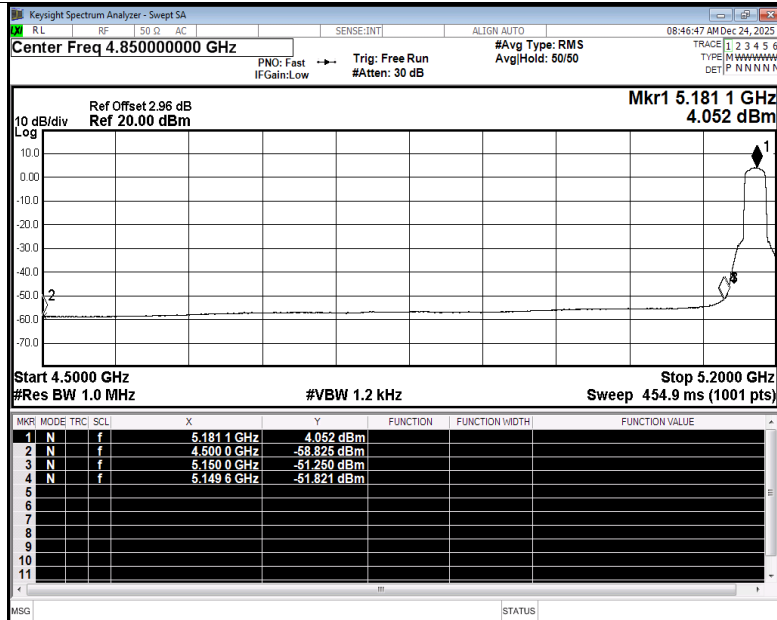

Restrict Band NVNT ax20 5180MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

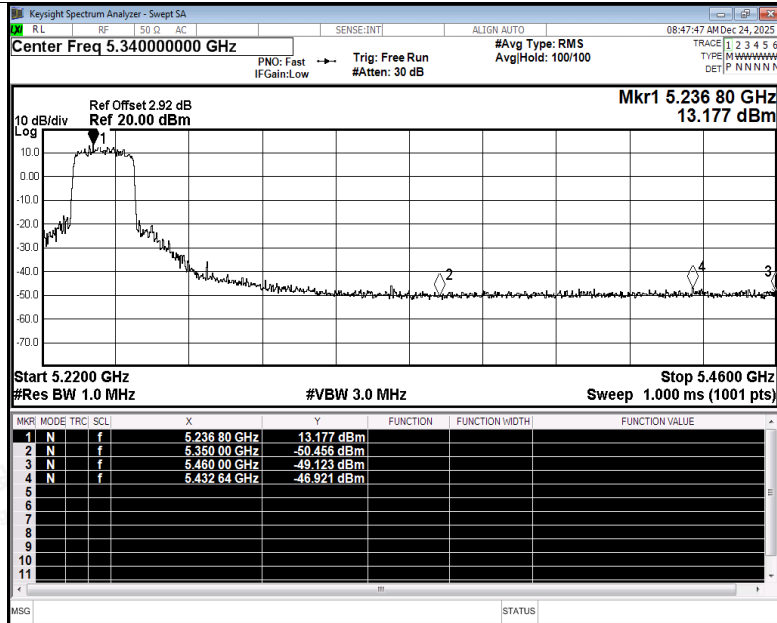

Restrict Band NVNT ax20 5240MHz Ant 2 Peak

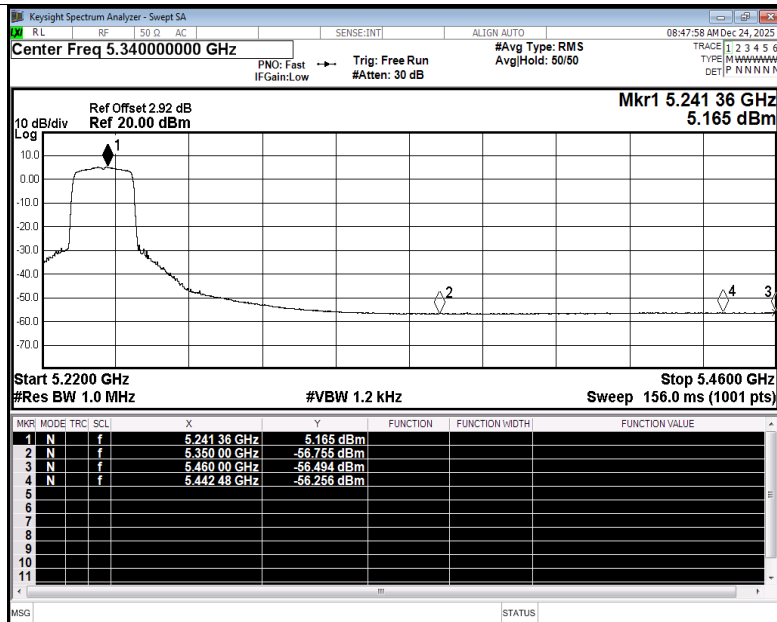

Restrict Band NVNT ax20 5240MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

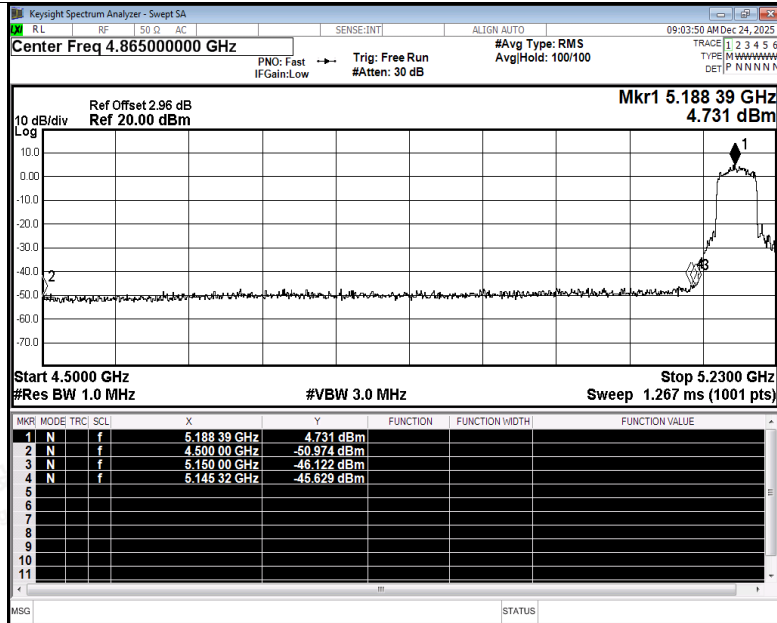


Restrict Band NVNT ax40 5190MHz Ant 2 Peak

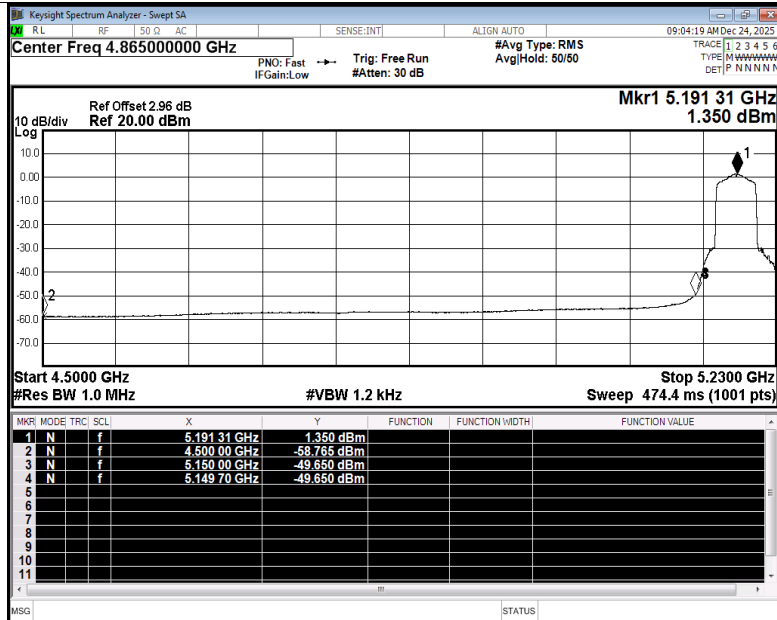


Restrict Band NVNT ax40 5190MHz Ant 2 Average



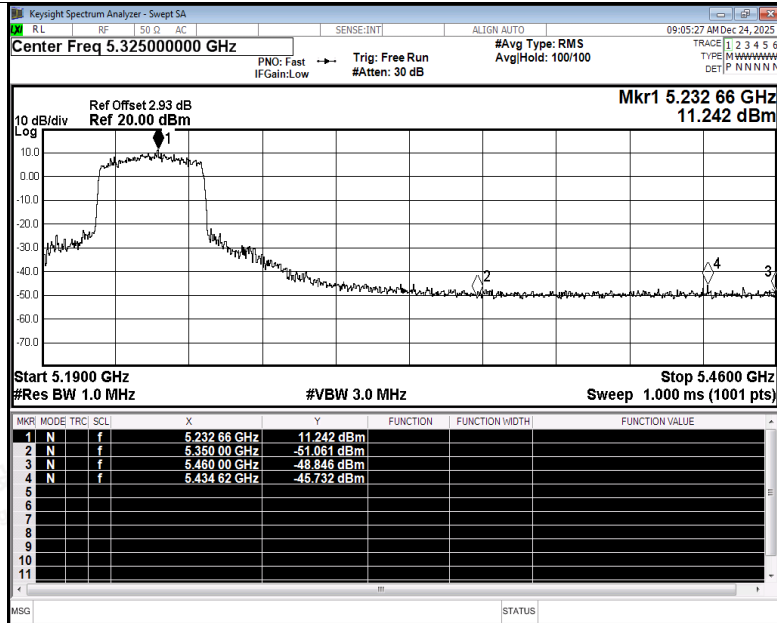

Restrict Band NVNT ax40 5230MHz Ant 2 Peak

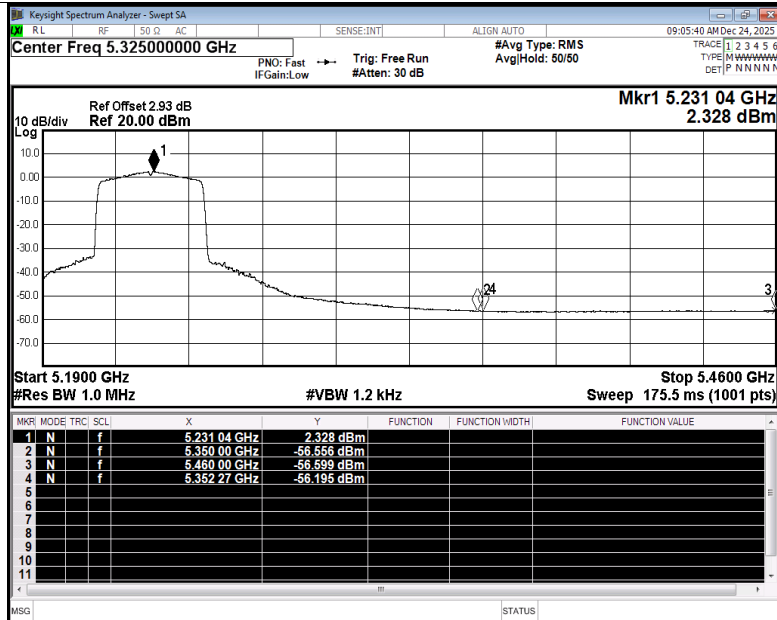

Restrict Band NVNT ax40 5230MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

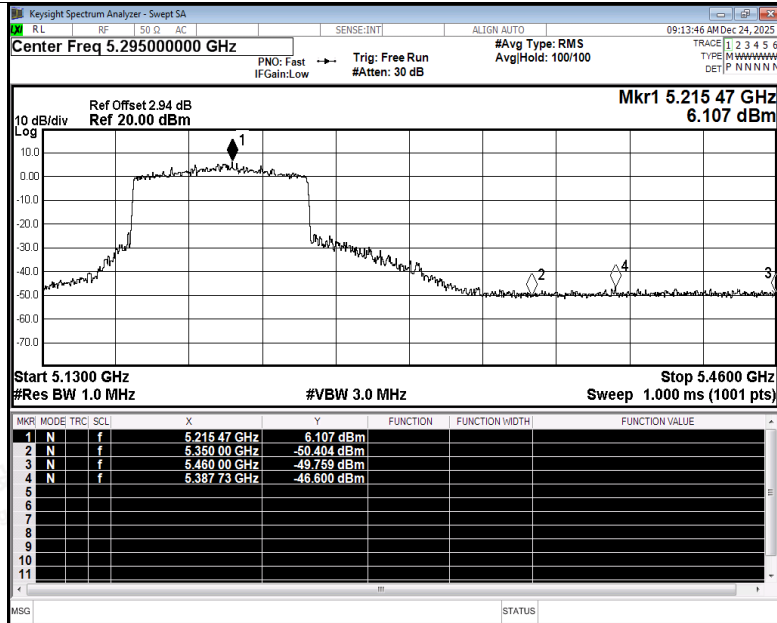

Restrict Band NVNT ax80 5210MHz Ant 2 Peak

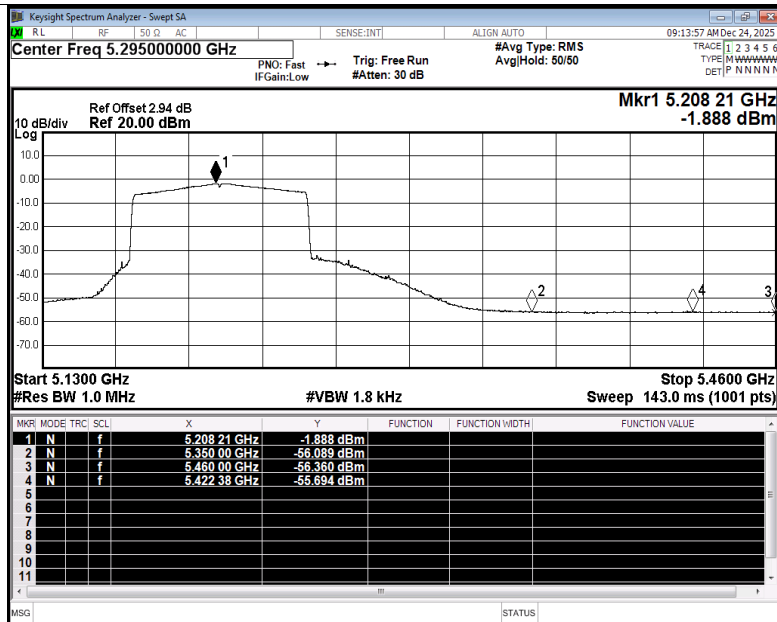

Restrict Band NVNT ax80 5210MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

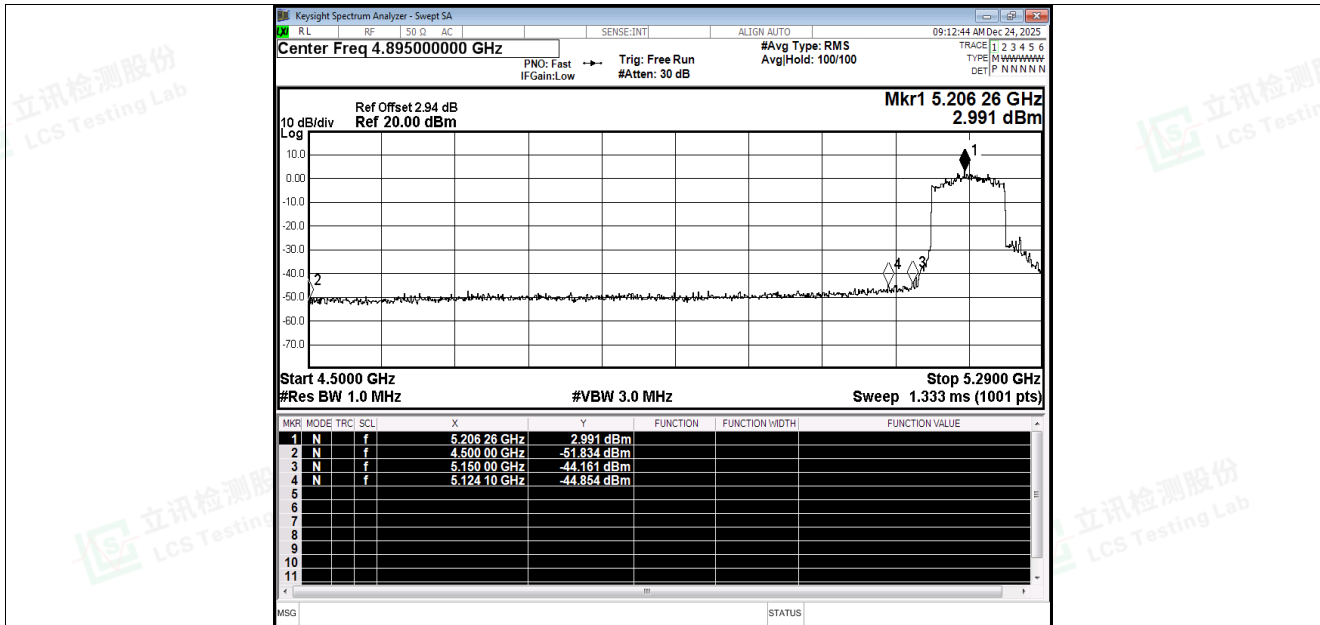


Restrict Band NVNT ax80 5210MHz Ant 2 Peak

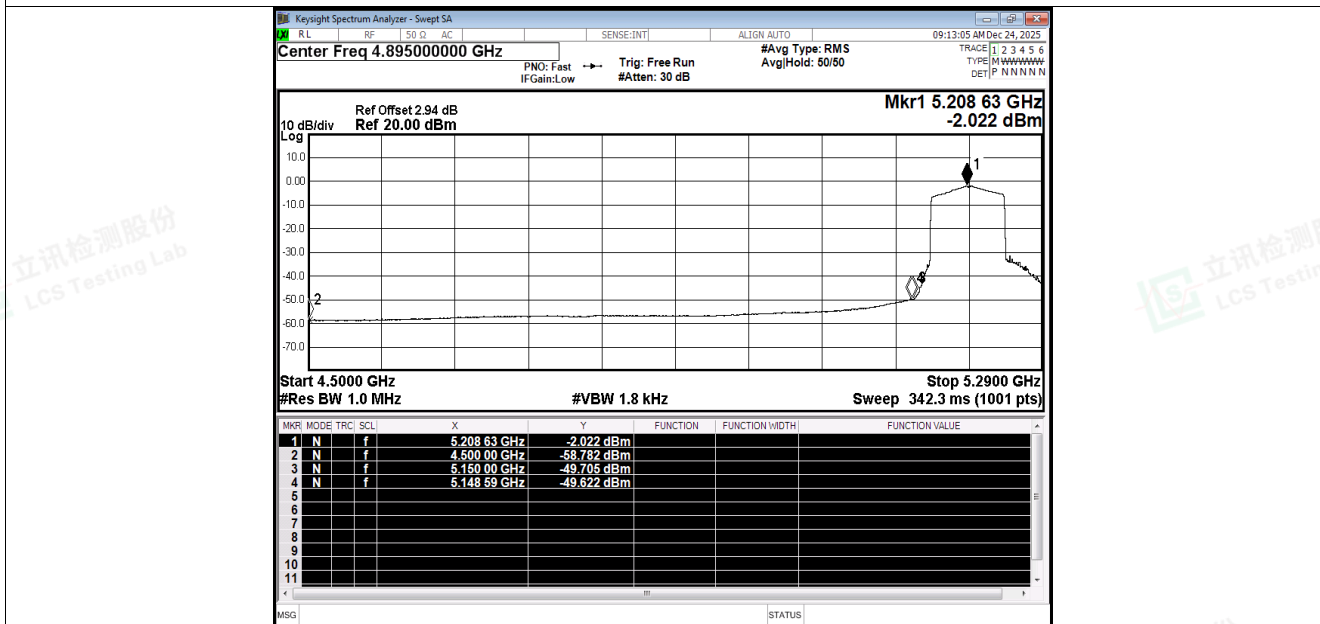


Restrict Band NVNT ax80 5210MHz Ant 2 Average



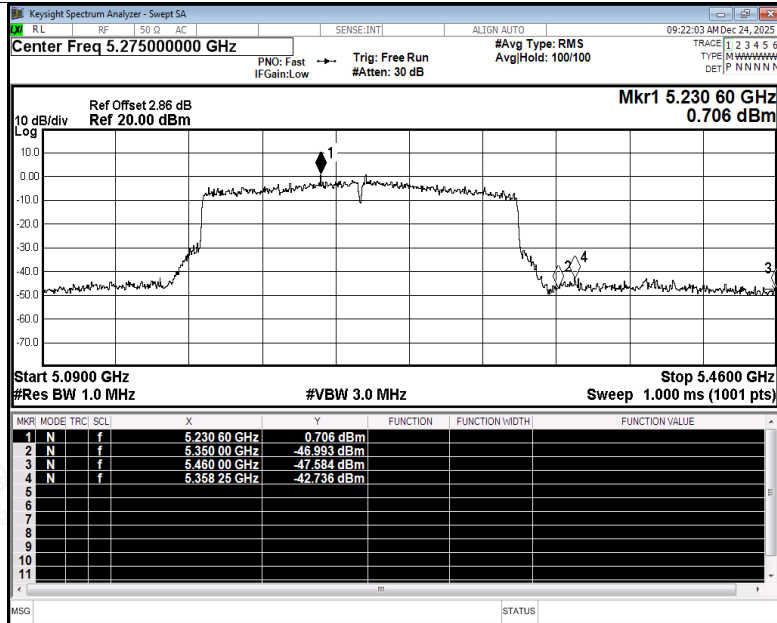

Restrict Band NVNT ax160 5250MHz Ant 2 Peak

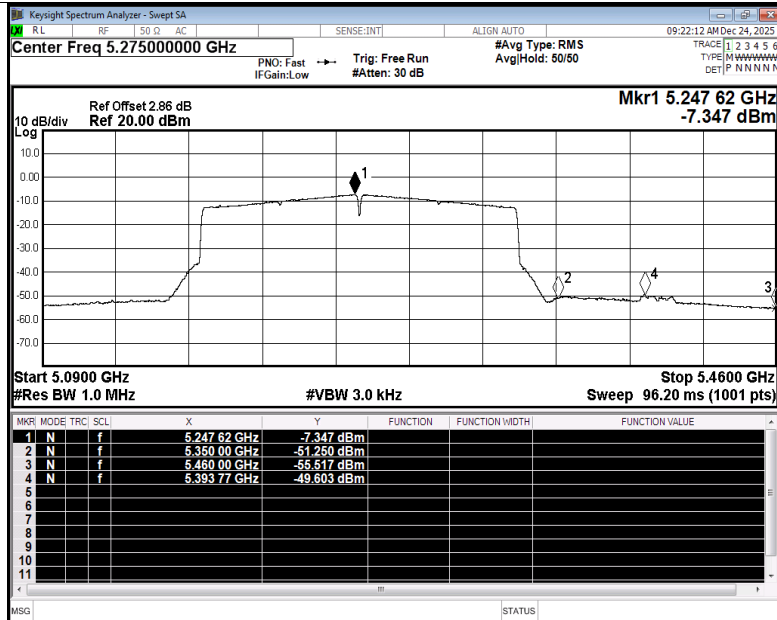

Restrict Band NVNT ax160 5250MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

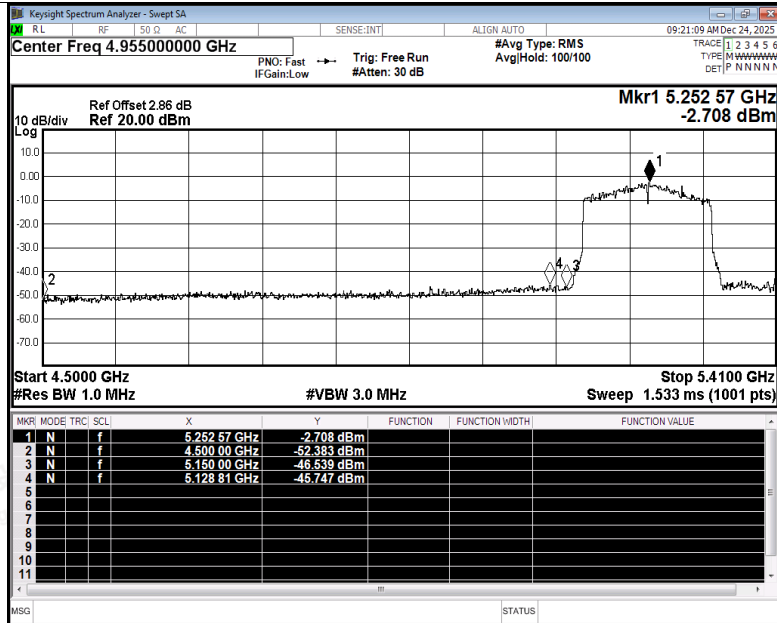

Restrict Band NVNT ax160 5250MHz Ant 2 Peak

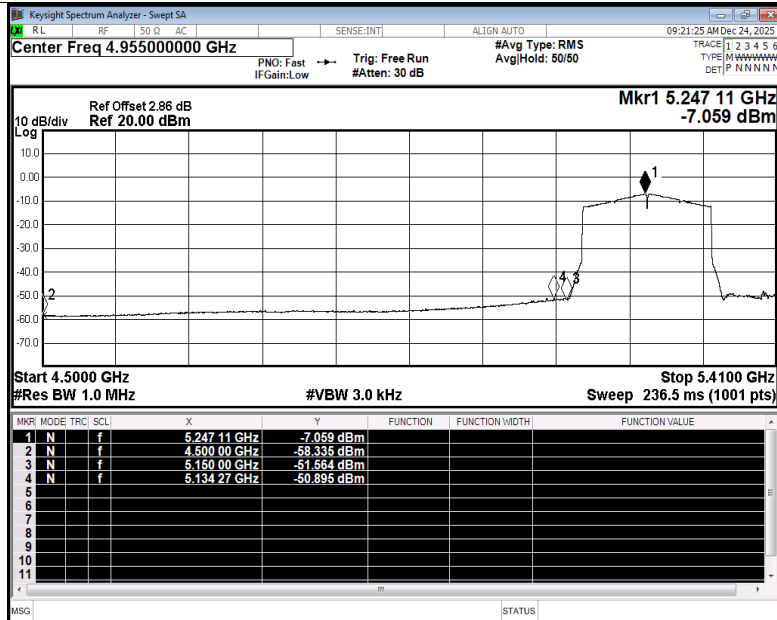

Restrict Band NVNT ax160 5250MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

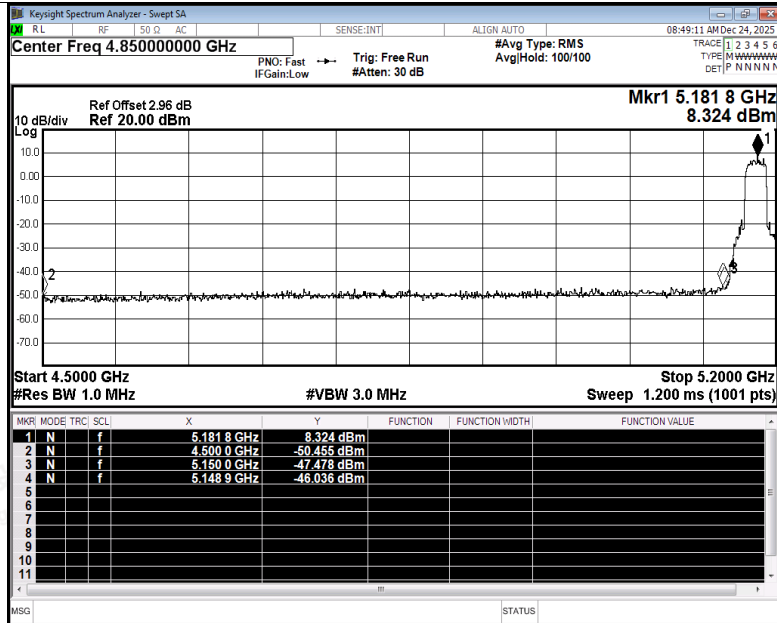

Restrict Band NVNT be20 5180MHz Ant 2 Peak

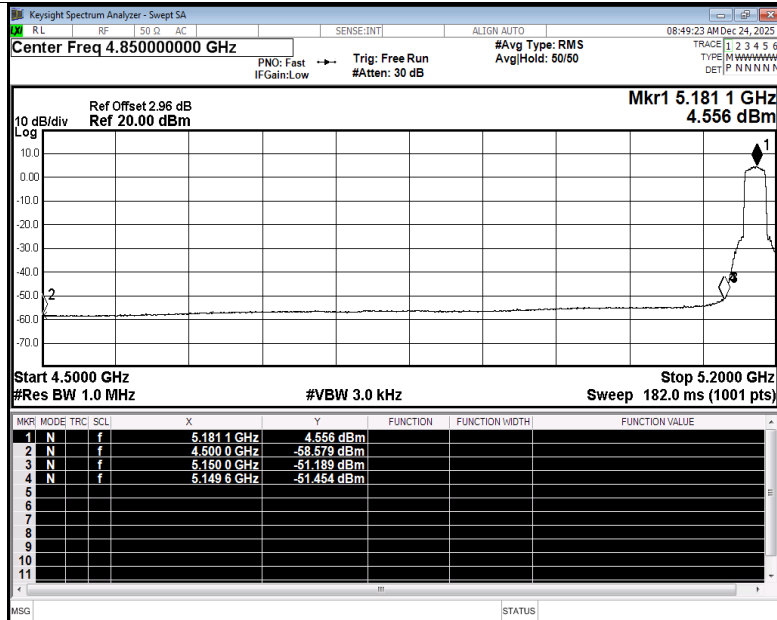

Restrict Band NVNT be20 5180MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

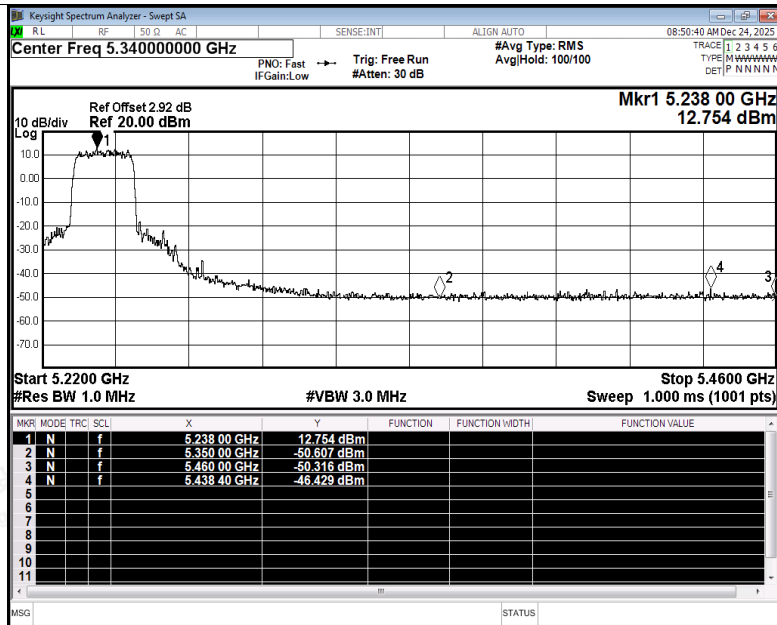


Restrict Band NVNT be20 5240MHz Ant 2 Peak

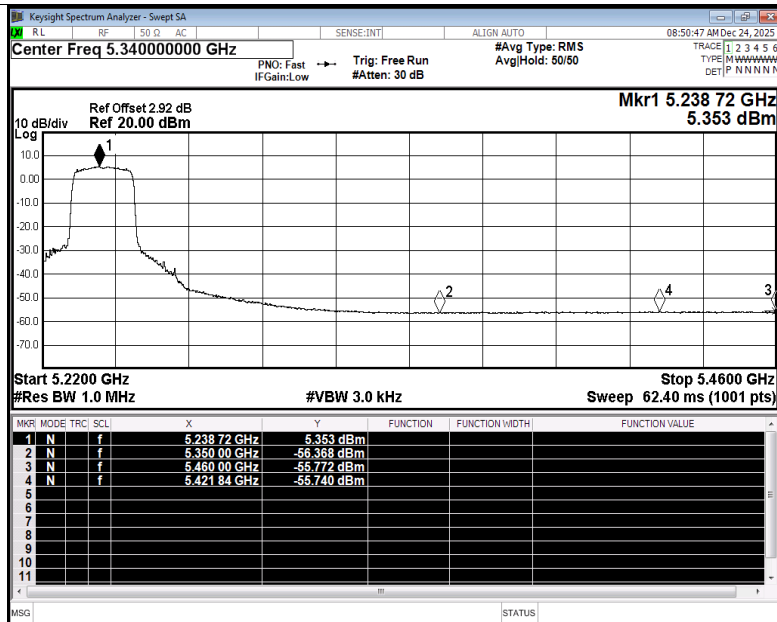


Restrict Band NVNT be20 5240MHz Ant 2 Average



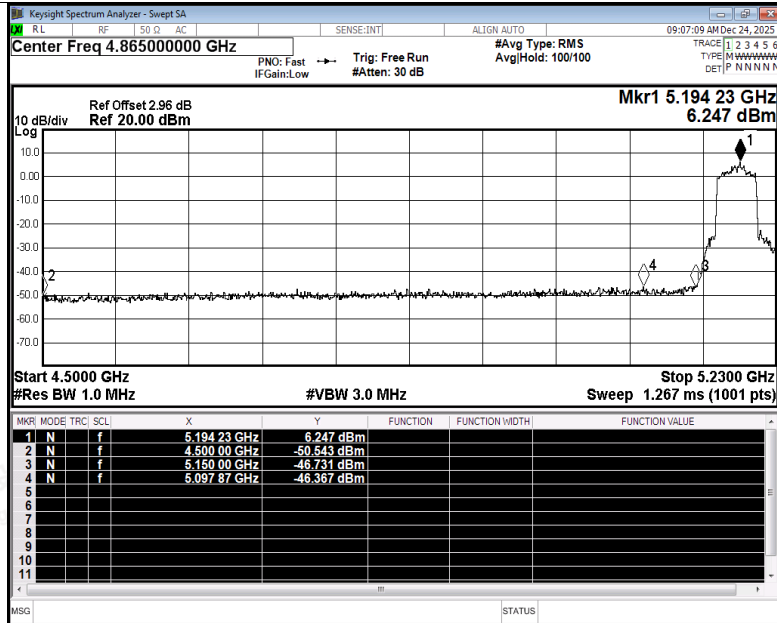


Restrict Band NVNT be40 5190MHz Ant 2 Peak

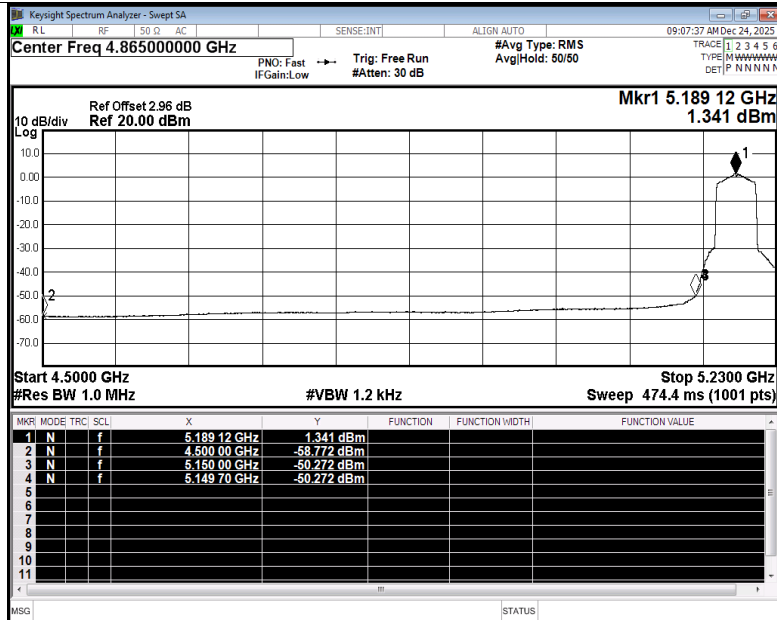


Restrict Band NVNT be40 5190MHz Ant 2 Average



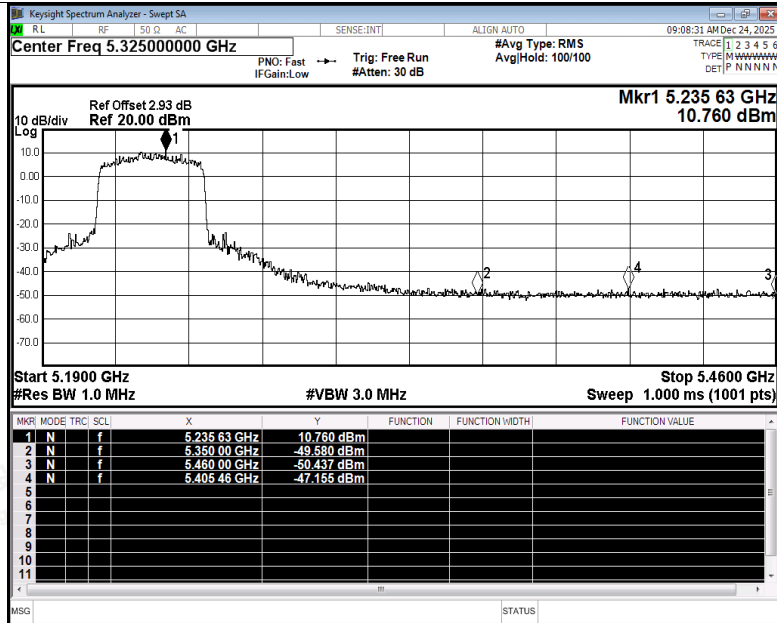


Restrict Band NVNT be40 5230MHz Ant 2 Peak

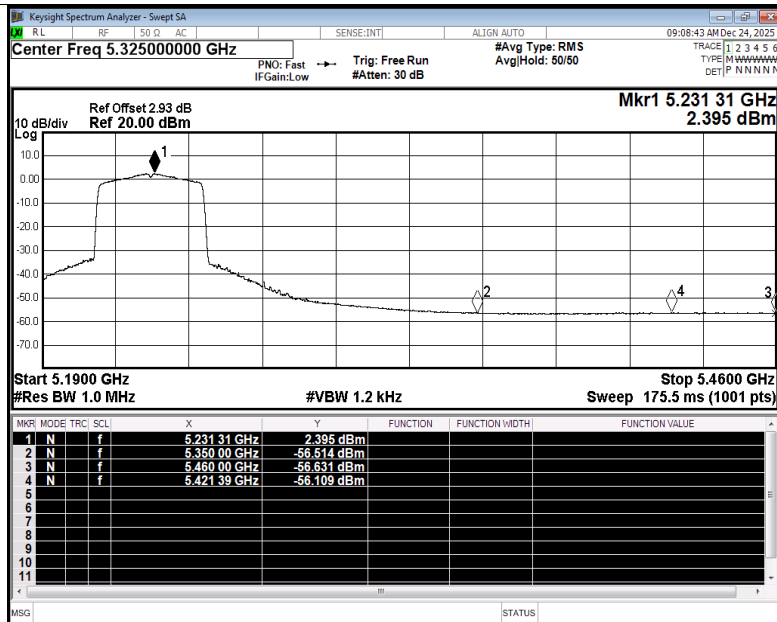


Restrict Band NVNT be40 5230MHz Ant 2 Average



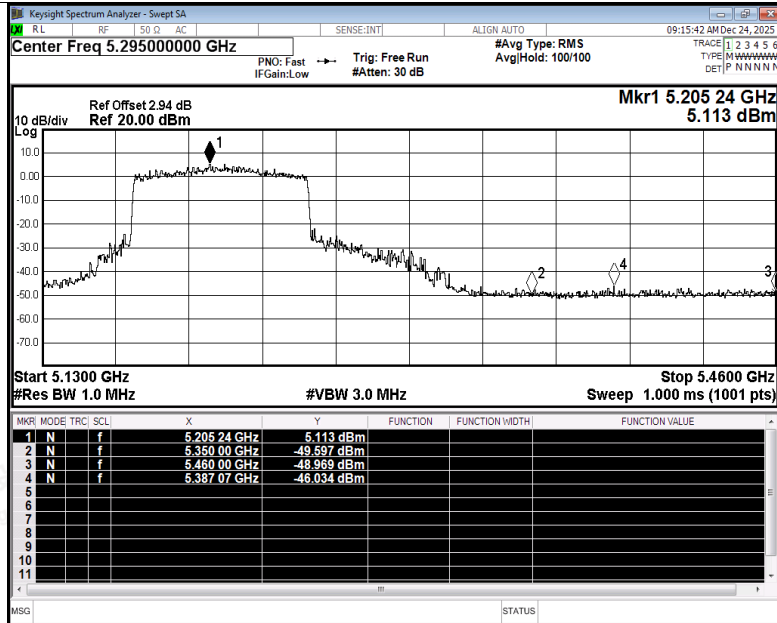


Restrict Band NVNT be80 5210MHz Ant 2 Peak

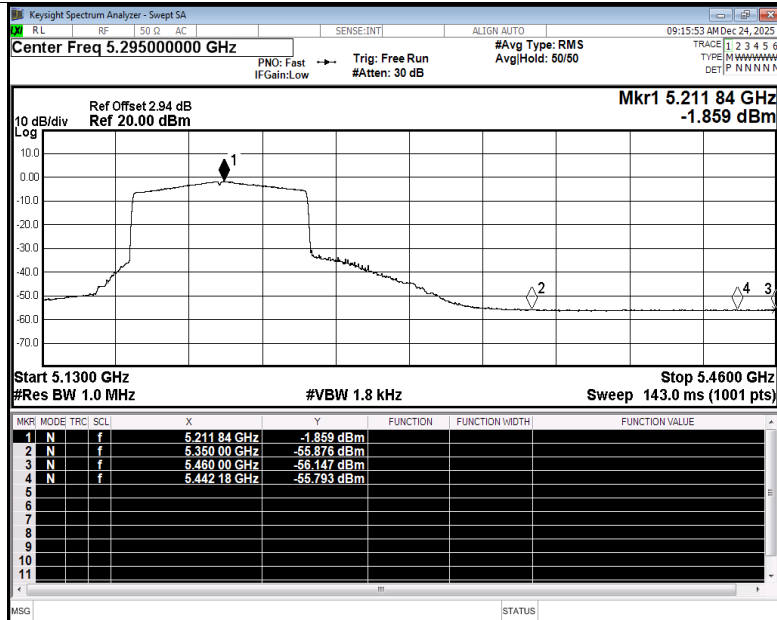


Restrict Band NVNT be80 5210MHz Ant 2 Average



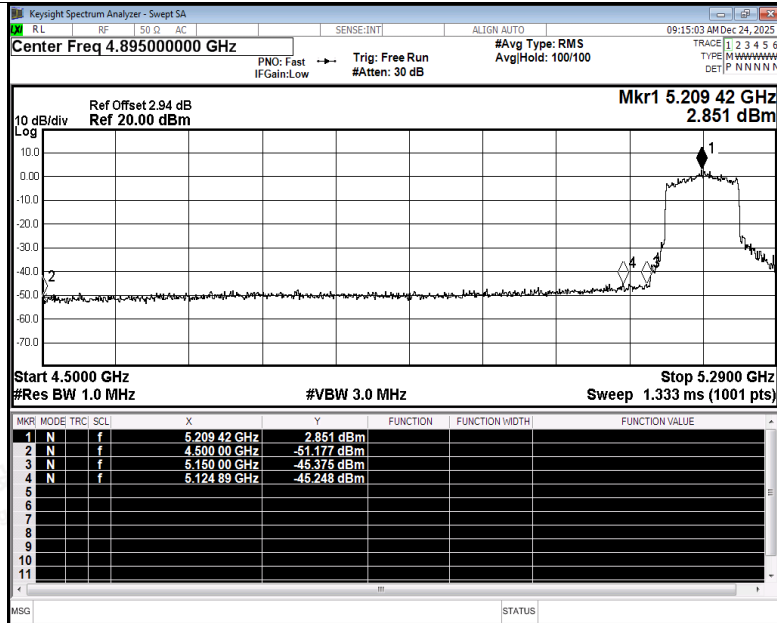

Restrict Band NVNT be80 5210MHz Ant 2 Peak

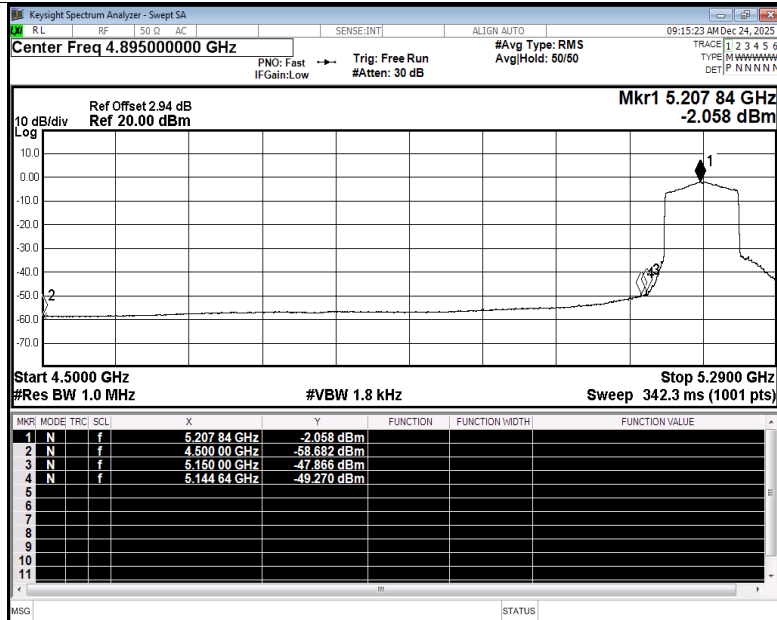

Restrict Band NVNT be80 5210MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

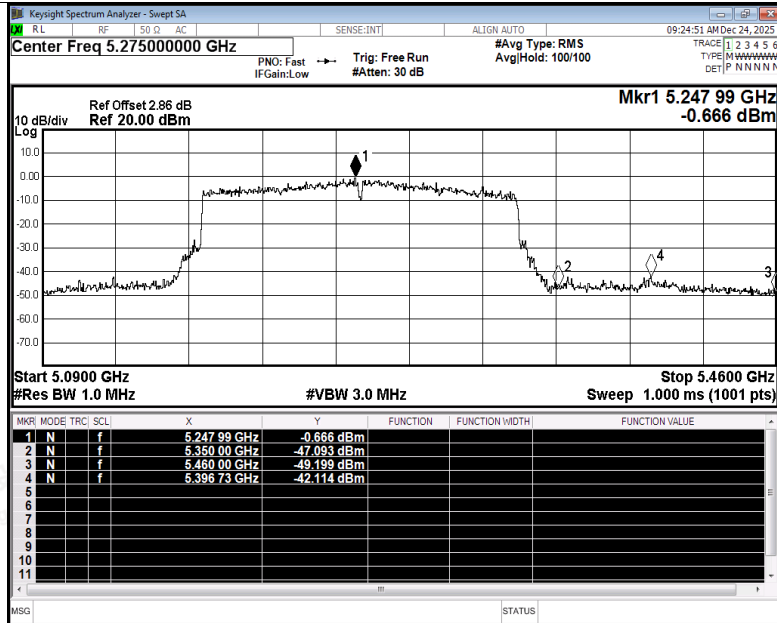

Restrict Band NVNT be160 5250MHz Ant 2 Peak

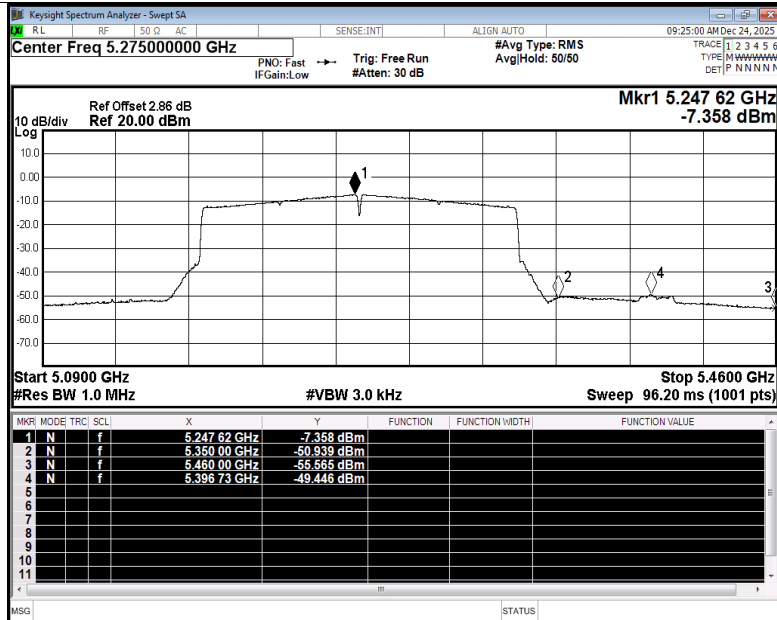

Restrict Band NVNT be160 5250MHz Ant 2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

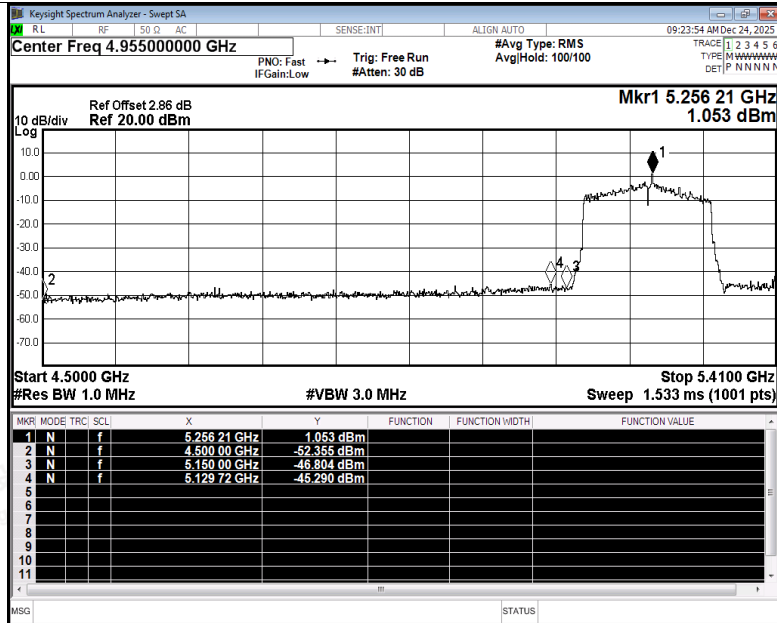

Restrict Band NVNT be160 5250MHz Ant 2 Peak

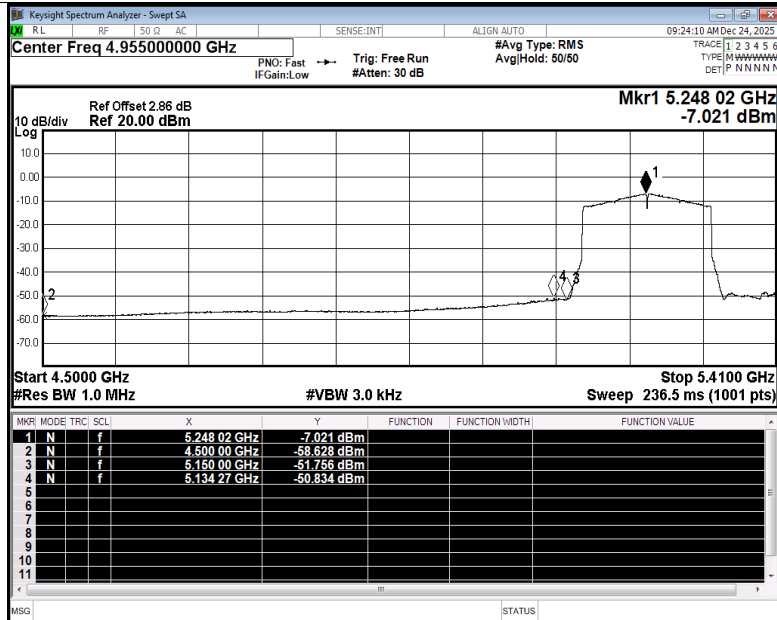

Restrict Band NVNT be160 5250MHz Ant 2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant3	4500	-62.33	6.49	39.39	Peak	68.2	Pass
NVNT	a	5180	Ant3	4500	-68.26	6.49	33.46	Average	54	Pass
NVNT	a	5180	Ant3	5148.9	-46.96	6.49	54.76	Peak	68.2	Pass
NVNT	a	5180	Ant3	5149.6	-51.82	6.49	49.9	Average	54	Pass
NVNT	a	5180	Ant3	5150	-48.51	6.49	53.21	Peak	68.2	Pass
NVNT	a	5180	Ant3	5150	-51.27	6.49	50.45	Average	54	Pass
NVNT	a	5240	Ant3	5350	-48.5	6.49	53.22	Peak	68.2	Pass
NVNT	a	5240	Ant3	5350	-56.62	6.49	45.1	Average	54	Pass
NVNT	a	5240	Ant3	5351.04	-46.96	6.49	54.76	Peak	68.2	Pass
NVNT	a	5240	Ant3	5421.12	-56.37	6.49	45.35	Average	54	Pass
NVNT	a	5240	Ant3	5460	-49.94	6.49	51.78	Peak	68.2	Pass
NVNT	a	5240	Ant3	5460	-57.06	6.49	44.66	Average	54	Pass
NVNT	n20	5180	Ant3	4500	-51.76	6.49	49.96	Peak	68.2	Pass
NVNT	n20	5180	Ant3	4500	-58.85	6.49	42.87	Average	54	Pass
NVNT	n20	5180	Ant3	5145.4	-45.18	6.49	56.54	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5149.6	-50.46	6.49	51.26	Average	54	Pass
NVNT	n20	5180	Ant3	5150	-44.91	6.49	56.81	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5150	-50.06	6.49	51.66	Average	54	Pass
NVNT	n20	5240	Ant3	5350	-50.02	6.49	51.7	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5350	-56.57	6.49	45.15	Average	54	Pass
NVNT	n20	5240	Ant3	5359.92	-46.96	6.49	54.76	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5421.12	-56.37	6.49	45.35	Average	54	Pass
NVNT	n20	5240	Ant3	5460	-50.94	6.49	50.78	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5460	-56.85	6.49	44.87	Average	54	Pass
NVNT	n40	5190	Ant3	4500	-52.34	6.49	49.38	Peak	68.2	Pass
NVNT	n40	5190	Ant3	4500	-59.01	6.49	42.71	Average	54	Pass
NVNT	n40	5190	Ant3	5149.7	-41.66	6.49	60.06	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5149.7	-50.03	6.49	51.69	Average	54	Pass
NVNT	n40	5190	Ant3	5150	-46.25	6.49	55.47	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5150	-49.41	6.49	52.31	Average	54	Pass
NVNT	n40	5230	Ant3	5350	-50.45	6.49	51.27	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5350	-56.36	6.49	45.36	Average	54	Pass
NVNT	n40	5230	Ant3	5361.45	-46.99	6.49	54.73	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5353.62	-56.21	6.49	45.51	Average	54	Pass
NVNT	n40	5230	Ant3	5460	-49.3	6.49	52.42	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5460	-56.98	6.49	44.74	Average	54	Pass
NVNT	ac20	5180	Ant3	4500	-50.69	6.49	51.03	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	4500	-58.97	6.49	42.75	Average	54	Pass
NVNT	ac20	5180	Ant3	5149.6	-44.17	6.49	57.55	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant3	5149.6	-50.65	6.49	51.07	Average	54	Pass
NVNT	ac20	5180	Ant3	5150	-44.17	6.49	57.55	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	5150	-50.24	6.49	51.48	Average	54	Pass
NVNT	ac20	5240	Ant3	5350	-49.98	6.49	51.74	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5350	-56.64	6.49	45.08	Average	54	Pass
NVNT	ac20	5240	Ant3	5408.88	-46.63	6.49	55.09	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5398.32	-56.57	6.49	45.15	Average	54	Pass
NVNT	ac20	5240	Ant3	5460	-49.46	6.49	52.26	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5460	-56.95	6.49	44.77	Average	54	Pass
NVNT	ac40	5190	Ant3	4500	-52	6.49	49.72	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	4500	-58.73	6.49	42.99	Average	54	Pass
NVNT	ac40	5190	Ant3	5143.86	-44.39	6.49	57.33	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5148.97	-48.94	6.49	52.78	Average	54	Pass
NVNT	ac40	5190	Ant3	5150	-44.06	6.49	57.66	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5150	-47.88	6.49	53.84	Average	54	Pass
NVNT	ac40	5230	Ant3	5350	-49.37	6.49	52.35	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5350	-55.75	6.49	45.97	Average	54	Pass
NVNT	ac40	5230	Ant3	5427.87	-46.7	6.49	55.02	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5350.11	-55.75	6.49	45.97	Average	54	Pass
NVNT	ac40	5230	Ant3	5460	-49.45	6.49	52.27	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5460	-57.04	6.49	44.68	Average	54	Pass
NVNT	ac80	5210	Ant3	5350	-51.09	6.49	50.63	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5350	-55.71	6.49	46.01	Average	54	Pass
NVNT	ac80	5210	Ant3	5381.13	-46.61	6.49	55.11	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5351.43	-55.38	6.49	46.34	Average	54	Pass
NVNT	ac80	5210	Ant3	5460	-50.08	6.49	51.64	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5460	-56.66	6.49	45.06	Average	54	Pass
NVNT	ac80	5210	Ant3	4500	-51.85	6.49	49.87	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	4500	-58.82	6.49	42.9	Average	54	Pass
NVNT	ac80	5210	Ant3	5149.38	-42.57	6.49	59.15	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5149.38	-50.22	6.49	51.5	Average	54	Pass
NVNT	ac80	5210	Ant3	5150	-45.21	6.49	56.51	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5150	-50.51	6.49	51.21	Average	54	Pass
NVNT	ac160	5250	Ant3	5350	-47.09	6.49	54.63	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5350	-51.64	6.49	50.08	Average	54	Pass
NVNT	ac160	5250	Ant3	5398.21	-43.39	6.49	58.33	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5397.47	-49.97	6.49	51.75	Average	54	Pass
NVNT	ac160	5250	Ant3	5460	-49.84	6.49	51.88	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5460	-56.5	6.49	45.22	Average	54	Pass
NVNT	ac160	5250	Ant3	4500	-52.51	6.49	49.21	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	4500	-58.79	6.49	42.93	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac160	5250	Ant3	5116.98	-42.95	6.49	58.77	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5115.16	-48.73	6.49	52.99	Average	54	Pass
NVNT	ac160	5250	Ant3	5150	-46.1	6.49	55.62	Peak	68.2	Pass
NVNT	ac160	5250	Ant3	5150	-51.35	6.49	50.37	Average	54	Pass
NVNT	ax20	5180	Ant3	4500	-51.39	6.49	50.33	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	4500	-58.38	6.49	43.34	Average	54	Pass
NVNT	ax20	5180	Ant3	5146.8	-44.28	6.49	57.44	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	5149.6	-49	6.49	52.72	Average	54	Pass
NVNT	ax20	5180	Ant3	5150	-45.99	6.49	55.73	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	5150	-48.73	6.49	52.99	Average	54	Pass
NVNT	ax20	5240	Ant3	5350	-50.64	6.49	51.08	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5350	-56.69	6.49	45.03	Average	54	Pass
NVNT	ax20	5240	Ant3	5447.28	-46.88	6.49	54.84	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5422.08	-55.95	6.49	45.77	Average	54	Pass
NVNT	ax20	5240	Ant3	5460	-49.25	6.49	52.47	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5460	-56.59	6.49	45.13	Average	54	Pass
NVNT	ax40	5190	Ant3	4500	-51.43	6.49	50.29	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	4500	-59.15	6.49	42.57	Average	54	Pass
NVNT	ax40	5190	Ant3	5149.7	-43.86	6.49	57.86	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	5149.7	-50.52	6.49	51.2	Average	54	Pass
NVNT	ax40	5190	Ant3	5150	-43.28	6.49	58.44	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	5150	-50.17	6.49	51.55	Average	54	Pass
NVNT	ax40	5230	Ant3	5350	-51.08	6.49	50.64	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5350	-56.07	6.49	45.65	Average	54	Pass
NVNT	ax40	5230	Ant3	5352.54	-47.17	6.49	54.55	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5350.38	-55.94	6.49	45.78	Average	54	Pass
NVNT	ax40	5230	Ant3	5460	-48.58	6.49	53.14	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5460	-57.07	6.49	44.65	Average	54	Pass
NVNT	ax80	5210	Ant3	5350	-48.67	6.49	53.05	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5350	-54.91	6.49	46.81	Average	54	Pass
NVNT	ax80	5210	Ant3	5353.41	-46.69	6.49	55.03	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5350.11	-54.91	6.49	46.81	Average	54	Pass
NVNT	ax80	5210	Ant3	5460	-49.13	6.49	52.59	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5460	-56.4	6.49	45.32	Average	54	Pass
NVNT	ax80	5210	Ant3	4500	-51.8	6.49	49.92	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	4500	-58.84	6.49	42.88	Average	54	Pass
NVNT	ax80	5210	Ant3	5117.78	-43.69	6.49	58.03	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5149.38	-49.31	6.49	52.41	Average	54	Pass
NVNT	ax80	5210	Ant3	5150	-45.2	6.49	56.52	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5150	-49.3	6.49	52.42	Average	54	Pass
NVNT	ax160	5250	Ant3	5350	-45.91	6.49	55.81	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax160	5250	Ant3	5350	-50.17	6.49	51.55	Average	54	Pass
NVNT	ax160	5250	Ant3	5394.51	-42.98	6.49	58.74	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5353.44	-49.19	6.49	52.53	Average	54	Pass
NVNT	ax160	5250	Ant3	5460	-50.47	6.49	51.25	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5460	-56.09	6.49	45.63	Average	54	Pass
NVNT	ax160	5250	Ant3	4500	-51.65	6.49	50.07	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	4500	-58.84	6.49	42.88	Average	54	Pass
NVNT	ax160	5250	Ant3	5066.02	-43.82	6.49	57.9	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5113.34	-50.28	6.49	51.44	Average	54	Pass
NVNT	ax160	5250	Ant3	5150	-46.41	6.49	55.31	Peak	68.2	Pass
NVNT	ax160	5250	Ant3	5150	-51.3	6.49	50.42	Average	54	Pass
NVNT	be20	5180	Ant3	4500	-52.32	6.49	49.4	Peak	68.2	Pass
NVNT	be20	5180	Ant3	4500	-58.73	6.49	42.99	Average	54	Pass
NVNT	be20	5180	Ant3	5144.7	-44.27	6.49	57.45	Peak	68.2	Pass
NVNT	be20	5180	Ant3	5149.6	-49.65	6.49	52.07	Average	54	Pass
NVNT	be20	5180	Ant3	5150	-46.25	6.49	55.47	Peak	68.2	Pass
NVNT	be20	5180	Ant3	5150	-49.84	6.49	51.88	Average	54	Pass
NVNT	be20	5240	Ant3	5350	-51.84	6.49	49.88	Peak	68.2	Pass
NVNT	be20	5240	Ant3	5350	-56.63	6.49	45.09	Average	54	Pass
NVNT	be20	5240	Ant3	5350.32	-46.95	6.49	54.77	Peak	68.2	Pass
NVNT	be20	5240	Ant3	5359.92	-55.75	6.49	45.97	Average	54	Pass
NVNT	be20	5240	Ant3	5460	-48.83	6.49	52.89	Peak	68.2	Pass
NVNT	be20	5240	Ant3	5460	-56.6	6.49	45.12	Average	54	Pass
NVNT	be40	5190	Ant3	4500	-50.93	6.49	50.79	Peak	68.2	Pass
NVNT	be40	5190	Ant3	4500	-59.05	6.49	42.67	Average	54	Pass
NVNT	be40	5190	Ant3	5148.97	-43.73	6.49	57.99	Peak	68.2	Pass
NVNT	be40	5190	Ant3	5149.7	-50.23	6.49	51.49	Average	54	Pass
NVNT	be40	5190	Ant3	5150	-44.68	6.49	57.04	Peak	68.2	Pass
NVNT	be40	5190	Ant3	5150	-49.34	6.49	52.38	Average	54	Pass
NVNT	be40	5230	Ant3	5350	-48.42	6.49	53.3	Peak	68.2	Pass
NVNT	be40	5230	Ant3	5350	-56.08	6.49	45.64	Average	54	Pass
NVNT	be40	5230	Ant3	5353.08	-45.98	6.49	55.74	Peak	68.2	Pass
NVNT	be40	5230	Ant3	5352.54	-55.85	6.49	45.87	Average	54	Pass
NVNT	be40	5230	Ant3	5460	-51.08	6.49	50.64	Peak	68.2	Pass
NVNT	be40	5230	Ant3	5460	-56.96	6.49	44.76	Average	54	Pass
NVNT	be80	5210	Ant3	5350	-48.75	6.49	52.97	Peak	68.2	Pass
NVNT	be80	5210	Ant3	5350	-55	6.49	46.72	Average	54	Pass
NVNT	be80	5210	Ant3	5373.54	-46.59	6.49	55.13	Peak	68.2	Pass
NVNT	be80	5210	Ant3	5351.1	-54.91	6.49	46.81	Average	54	Pass
NVNT	be80	5210	Ant3	5460	-49.61	6.49	52.11	Peak	68.2	Pass
NVNT	be80	5210	Ant3	5460	-56.16	6.49	45.56	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	be80	5210	Ant3	4500	-52.35	6.49	49.37	Peak	68.2	Pass
NVNT	be80	5210	Ant3	4500	-59	6.49	42.72	Average	54	Pass
NVNT	be80	5210	Ant3	5148.59	-42.94	6.49	58.78	Peak	68.2	Pass
NVNT	be80	5210	Ant3	5143.85	-49.21	6.49	52.51	Average	54	Pass
NVNT	be80	5210	Ant3	5150	-45.78	6.49	55.94	Peak	68.2	Pass
NVNT	be80	5210	Ant3	5150	-49.49	6.49	52.23	Average	54	Pass
NVNT	be160	5250	Ant3	5350	-44.26	6.49	57.46	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5350	-50.28	6.49	51.44	Average	54	Pass
NVNT	be160	5250	Ant3	5406.72	-42.88	6.49	58.84	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5352.7	-49.13	6.49	52.59	Average	54	Pass
NVNT	be160	5250	Ant3	5460	-50.05	6.49	51.67	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5460	-56.1	6.49	45.62	Average	54	Pass
NVNT	be160	5250	Ant3	4500	-51.15	6.49	50.57	Peak	68.2	Pass
NVNT	be160	5250	Ant3	4500	-58.61	6.49	43.11	Average	54	Pass
NVNT	be160	5250	Ant3	5114.25	-44.72	6.49	57	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5113.34	-50.72	6.49	51	Average	54	Pass
NVNT	be160	5250	Ant3	5150	-47.59	6.49	54.13	Peak	68.2	Pass
NVNT	be160	5250	Ant3	5150	-51.3	6.49	50.42	Average	54	Pass



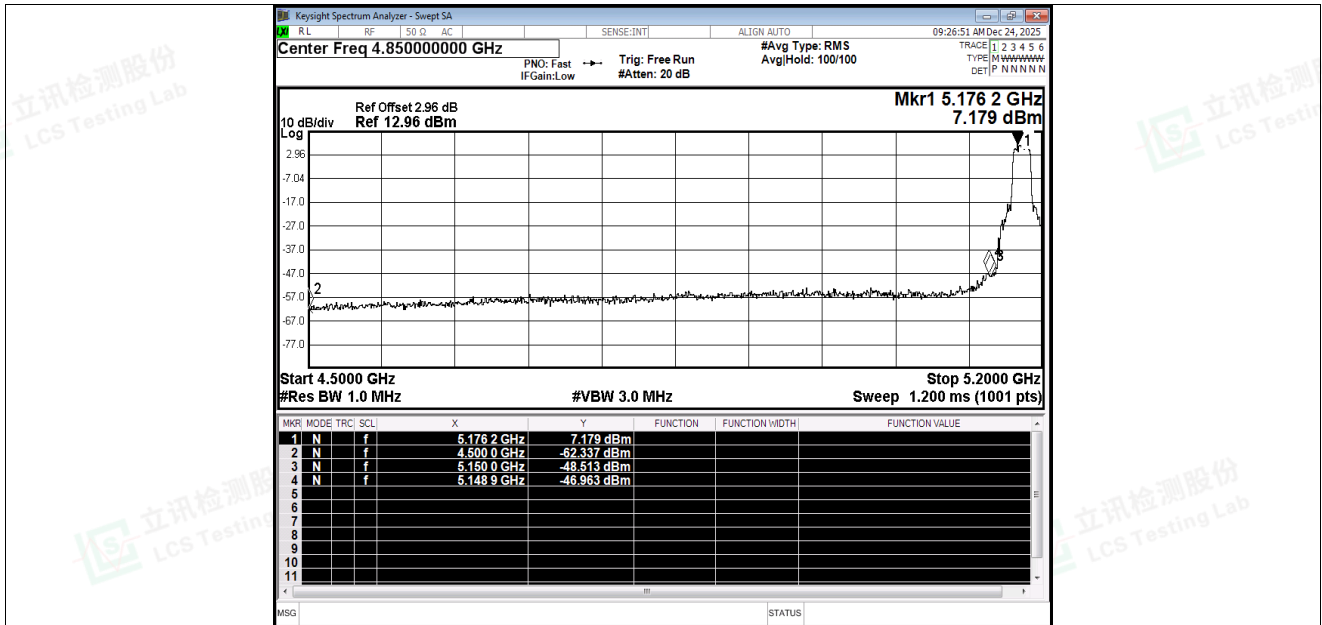

Restrict Band NVNT a 5180MHz Ant3 Peak

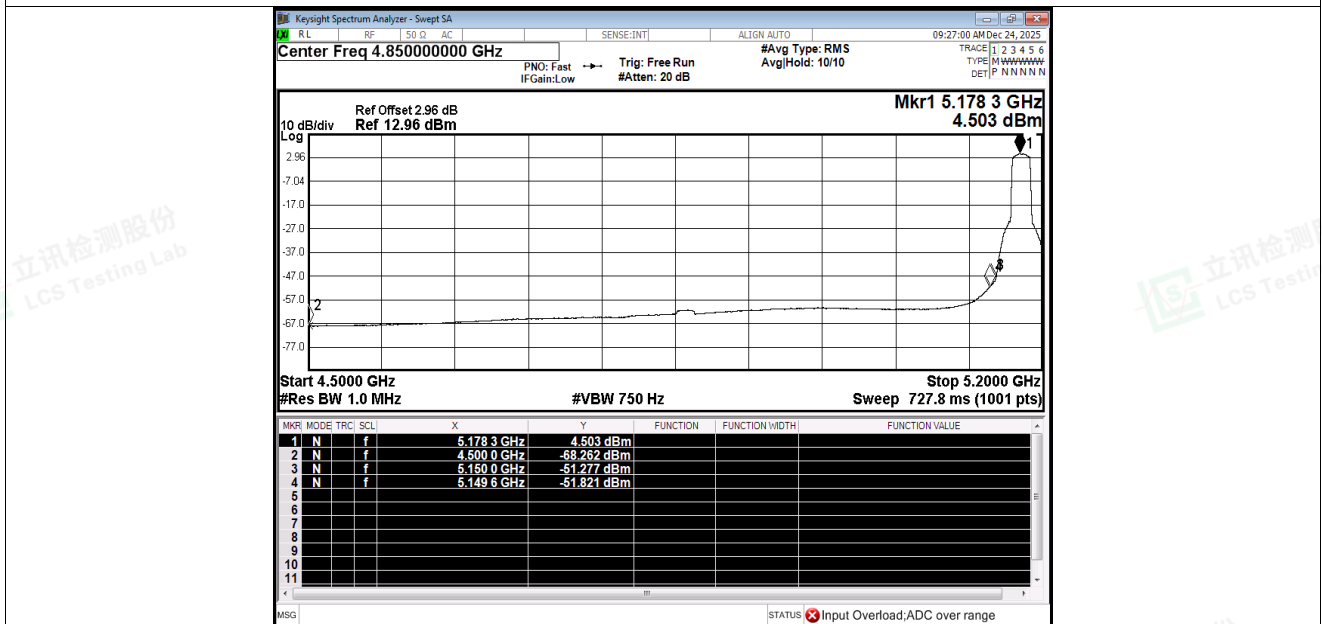

Restrict Band NVNT a 5180MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

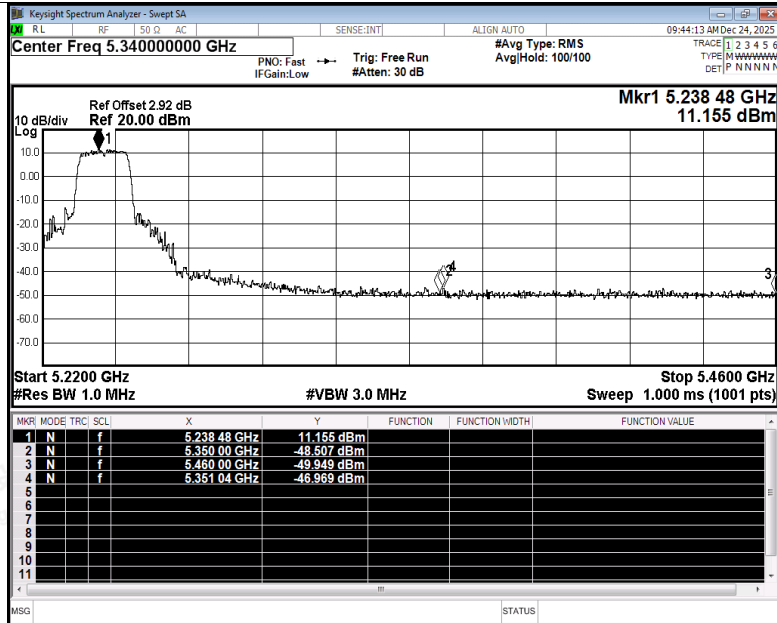


Restrict Band NVNT a 5240MHz Ant3 Peak

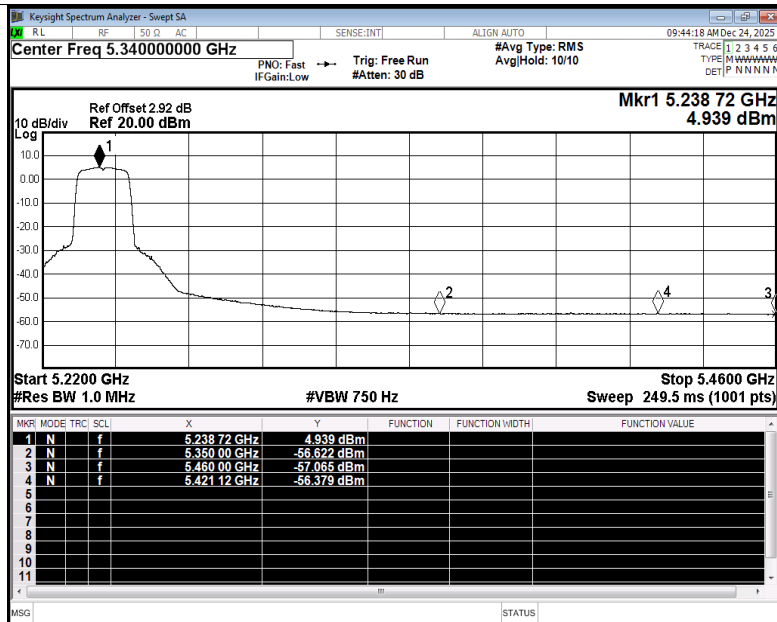


Restrict Band NVNT a 5240MHz Ant3 Average



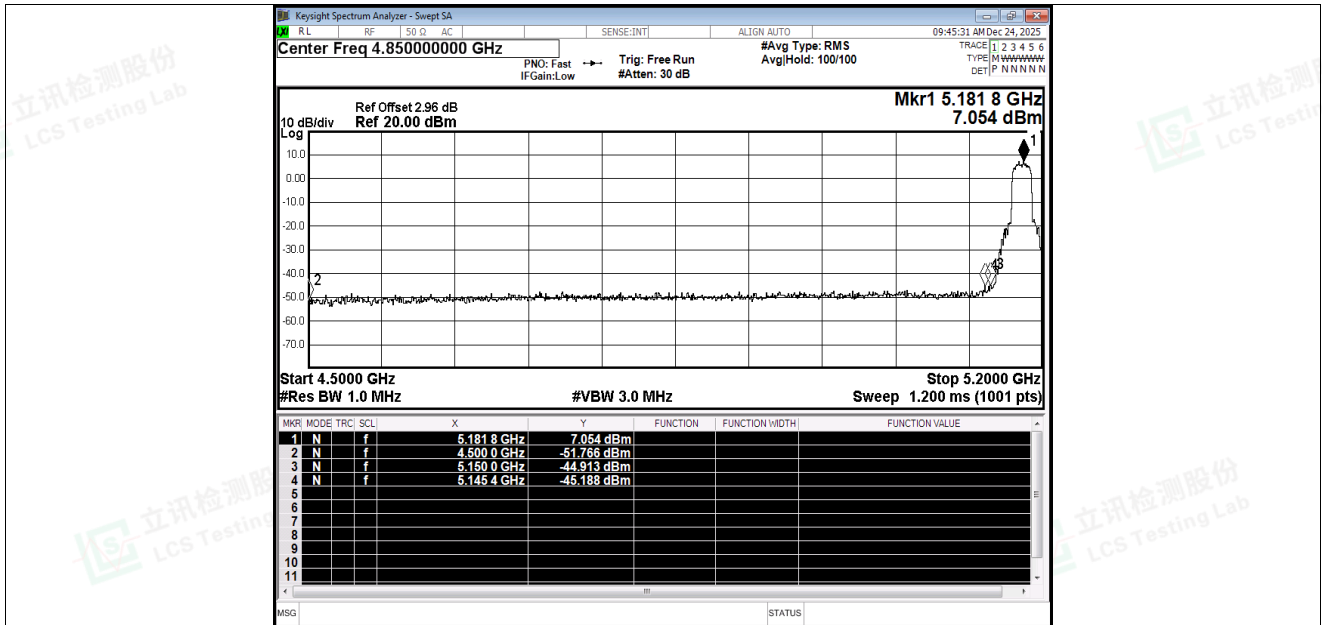

Restrict Band NVNT n20 5180MHz Ant3 Peak

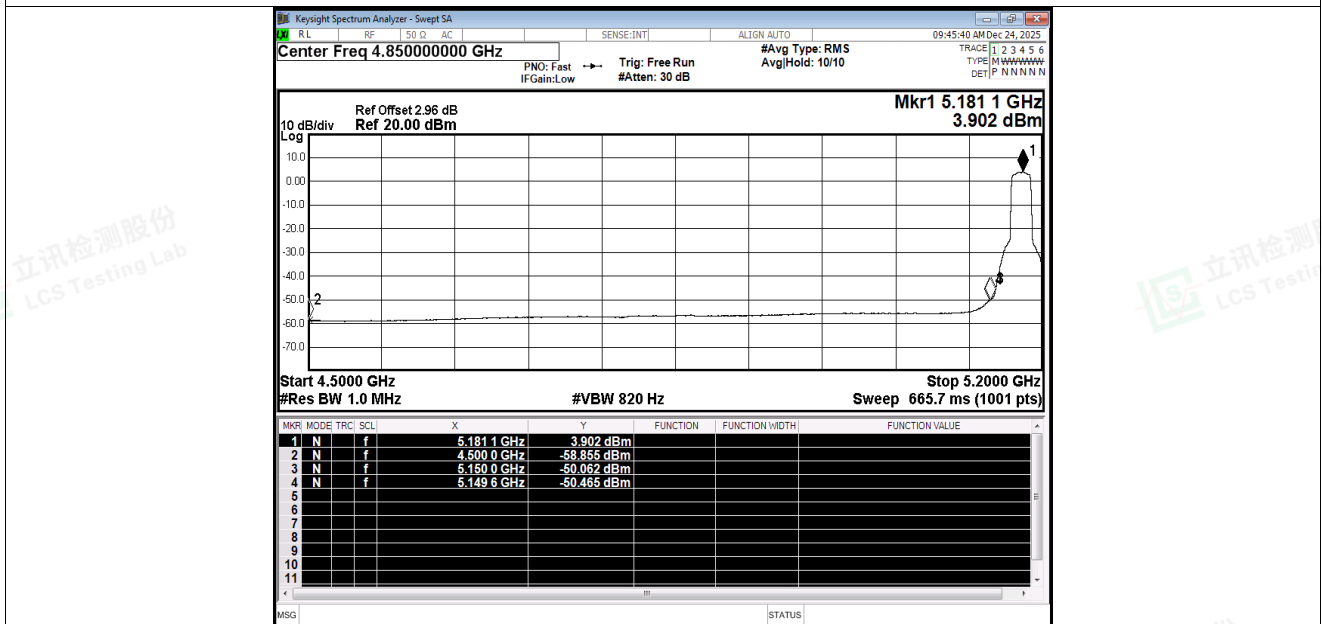

Restrict Band NVNT n20 5180MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

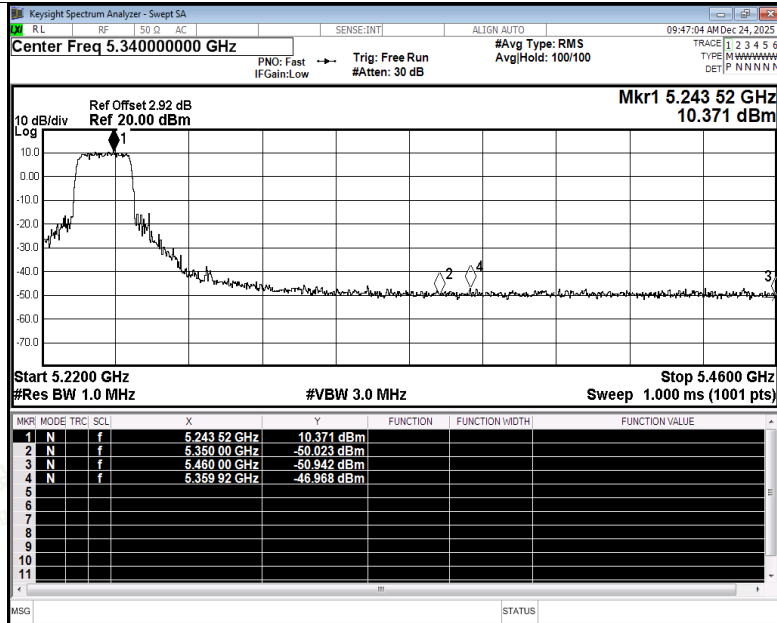

Restrict Band NVNT n20 5240MHz Ant3 Peak

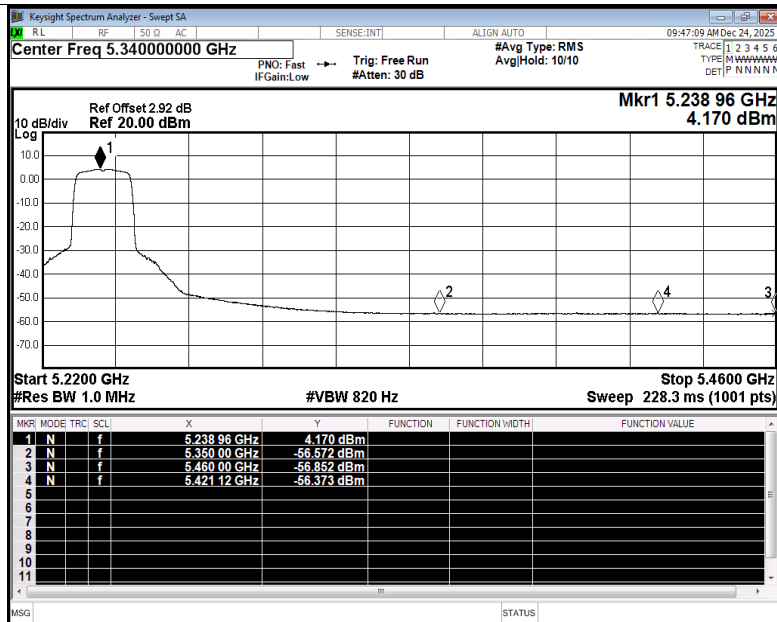

Restrict Band NVNT n20 5240MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

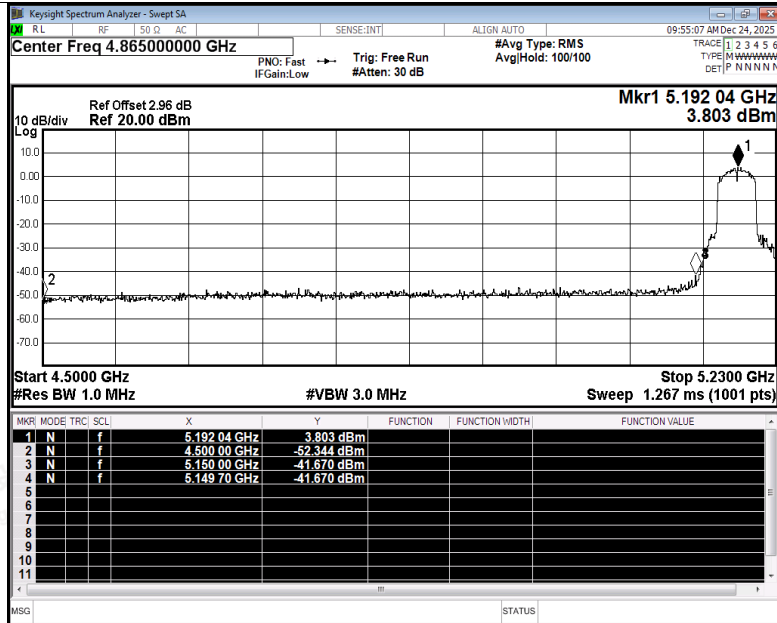


Restrict Band NVNT n40 5190MHz Ant3 Peak

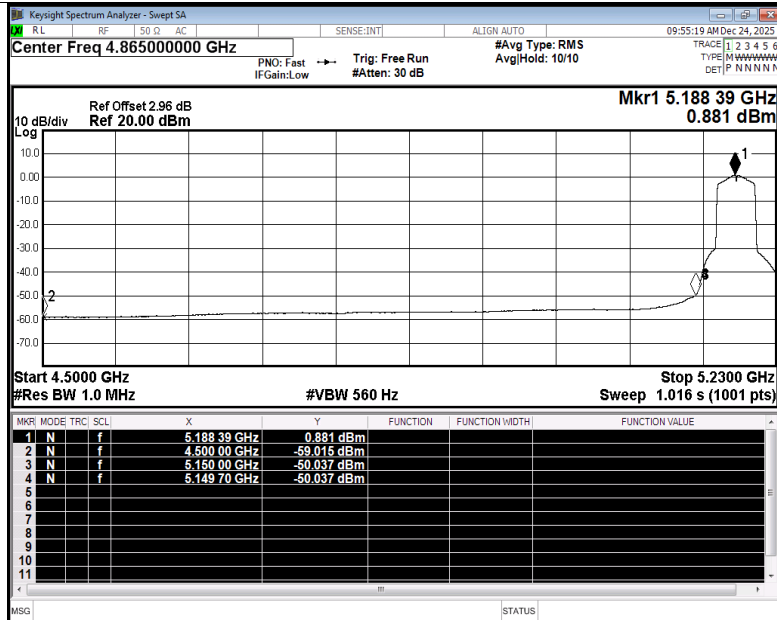


Restrict Band NVNT n40 5190MHz Ant3 Average



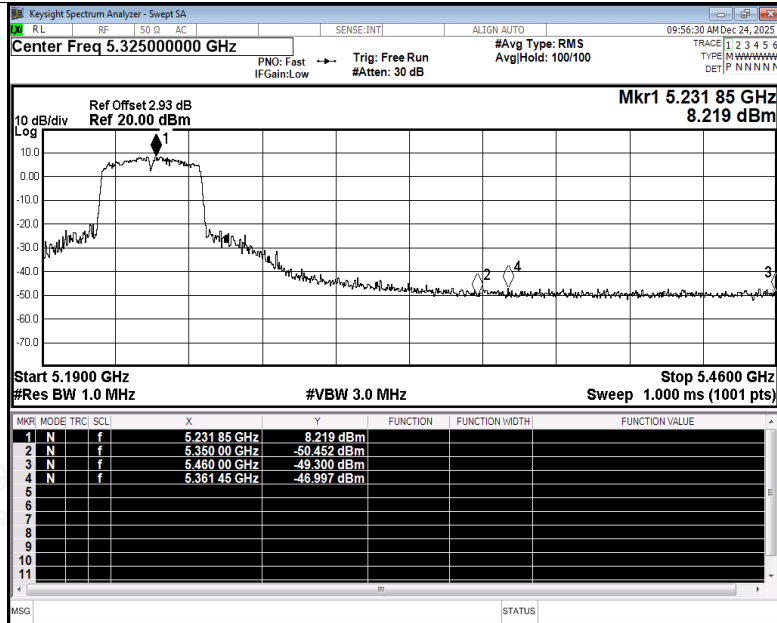


Restrict Band NVNT n40 5230MHz Ant3 Peak

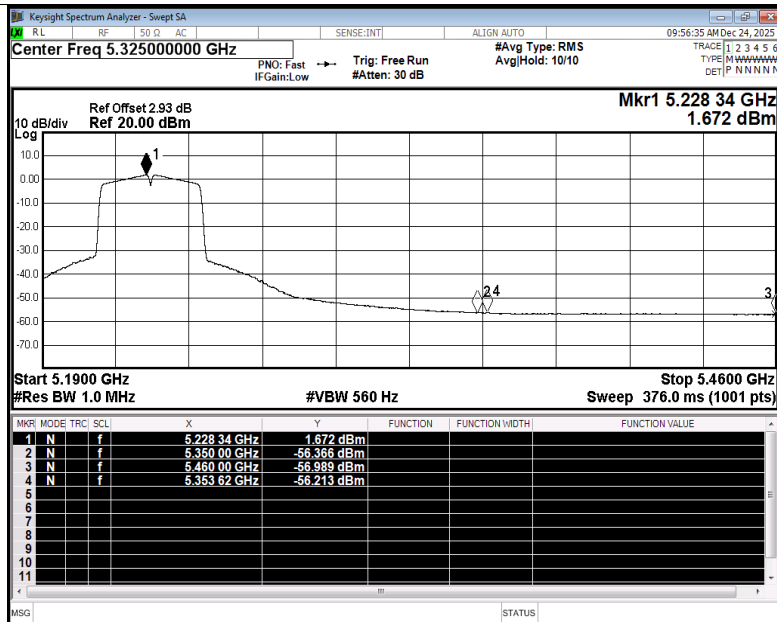


Restrict Band NVNT n40 5230MHz Ant3 Average



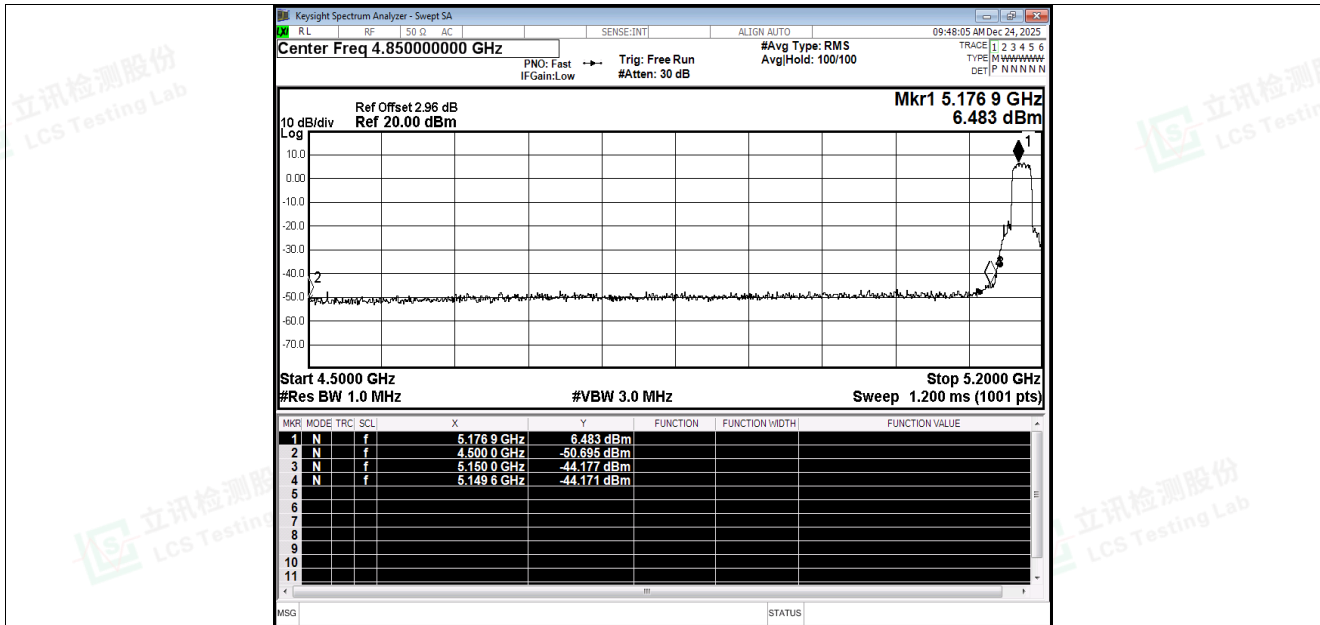


Restrict Band NVNT ac20 5180MHz Ant3 Peak

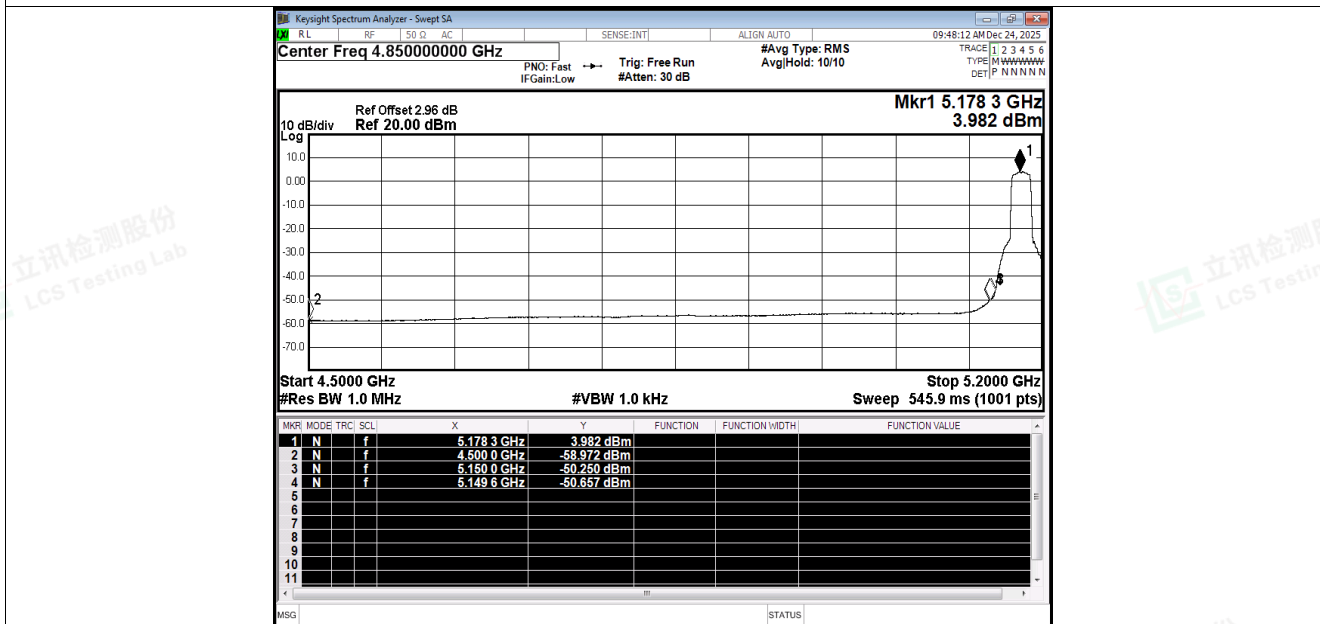


Restrict Band NVNT ac20 5180MHz Ant3 Average



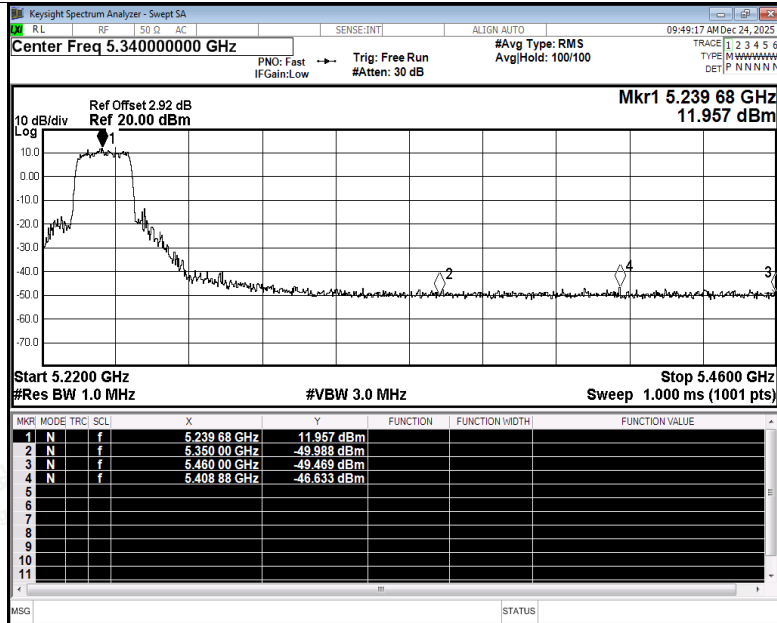

Restrict Band NVNT ac20 5240MHz Ant3 Peak

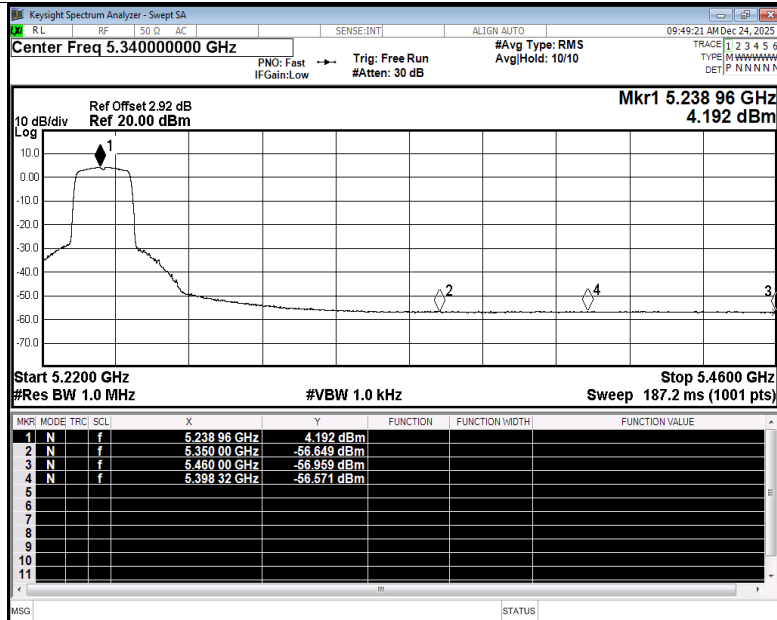

Restrict Band NVNT ac20 5240MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

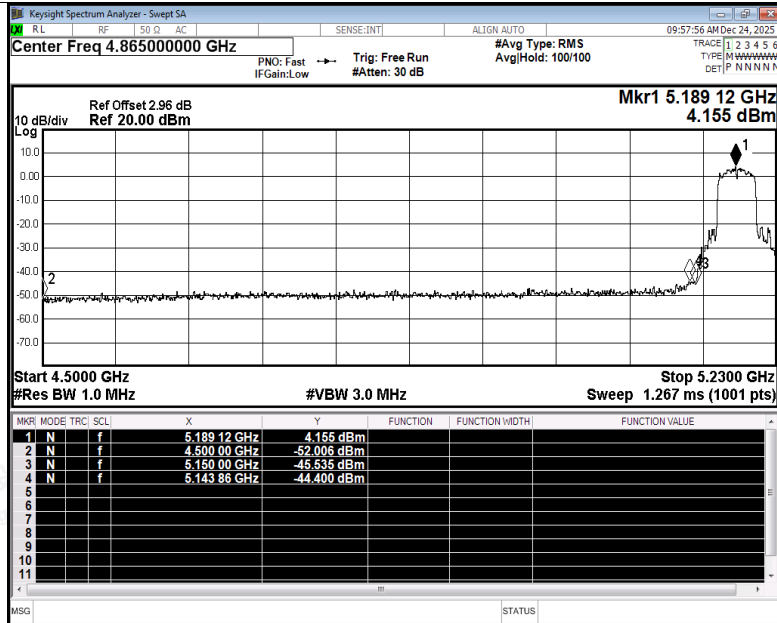

Restrict Band NVNT ac40 5190MHz Ant3 Peak

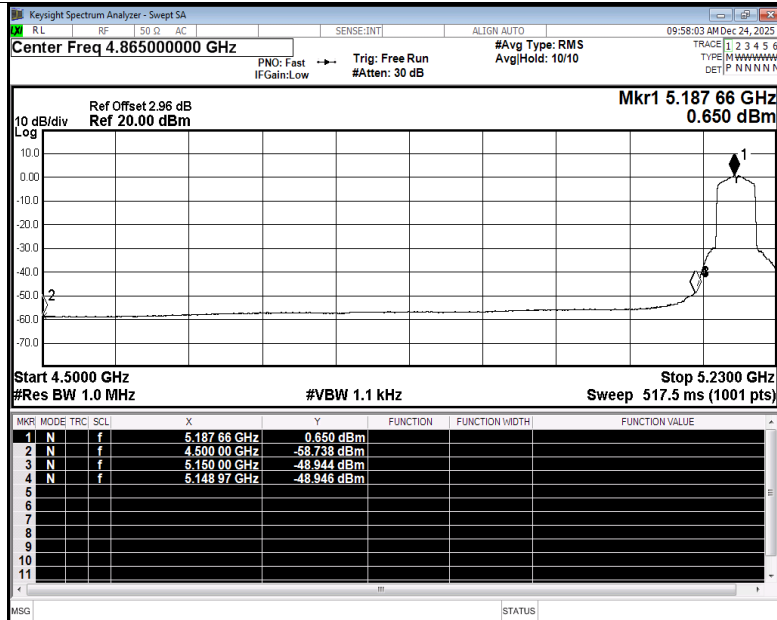

Restrict Band NVNT ac40 5190MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

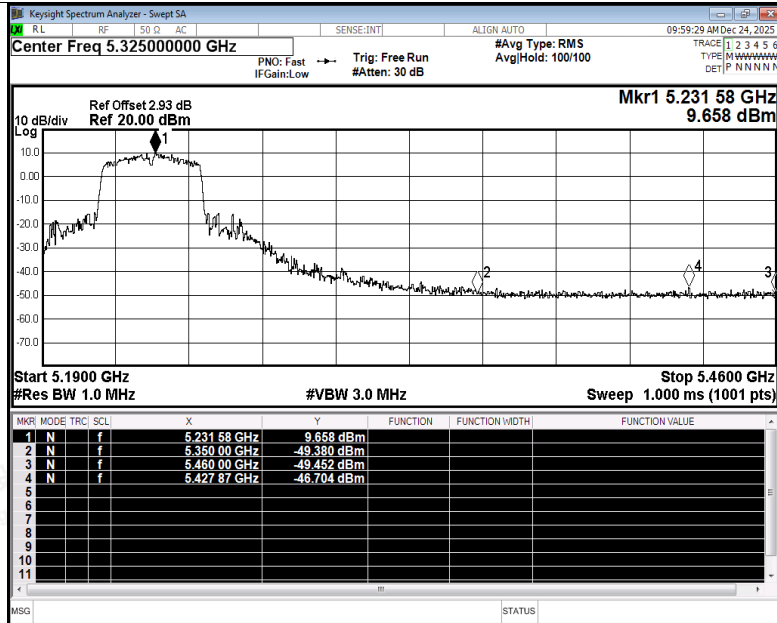


Restrict Band NVNT ac40 5230MHz Ant3 Peak

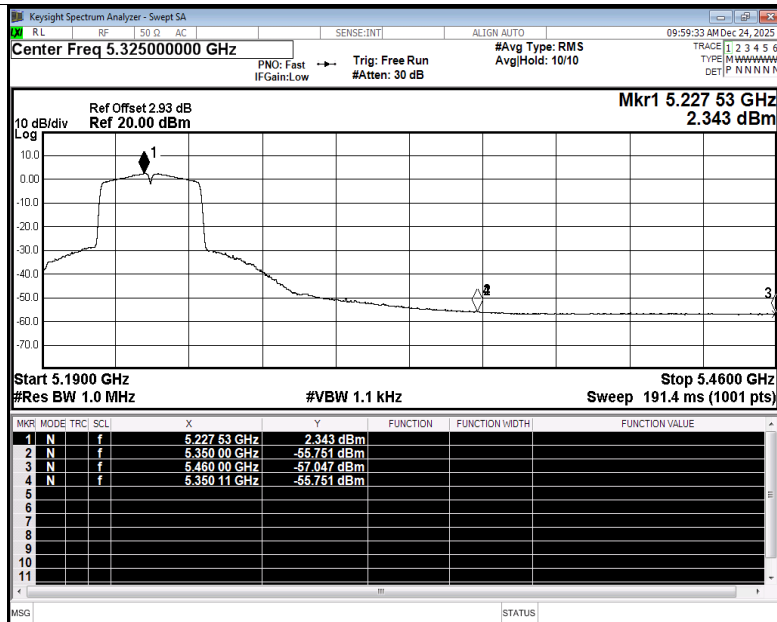


Restrict Band NVNT ac40 5230MHz Ant3 Average



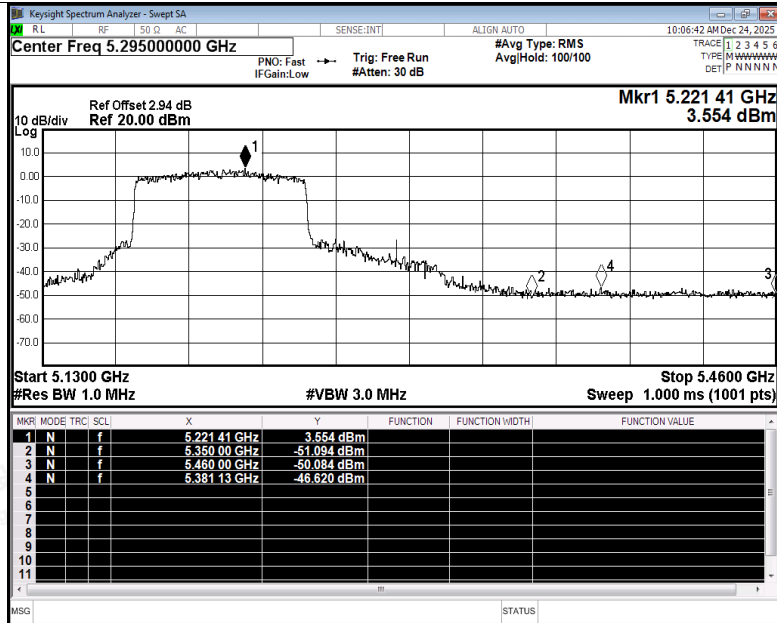


Restrict Band NVNT ac80 5210MHz Ant3 Peak

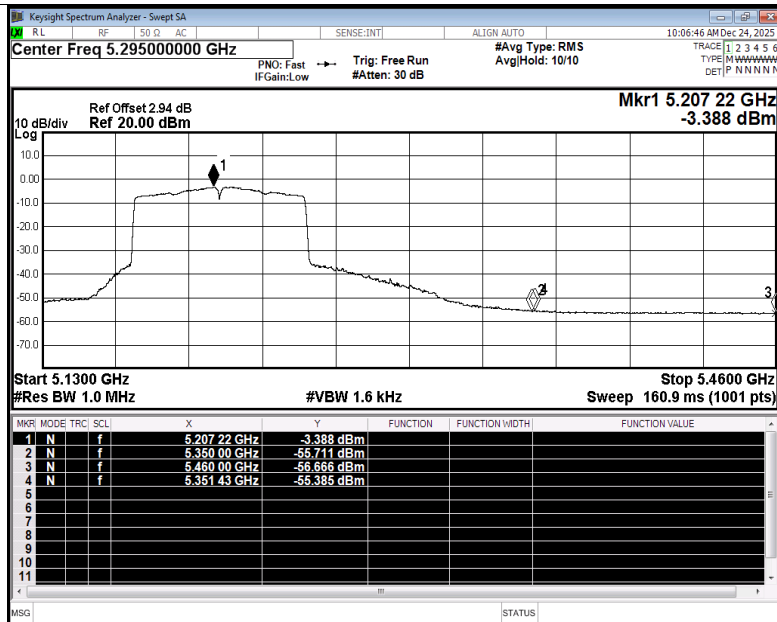


Restrict Band NVNT ac80 5210MHz Ant3 Average



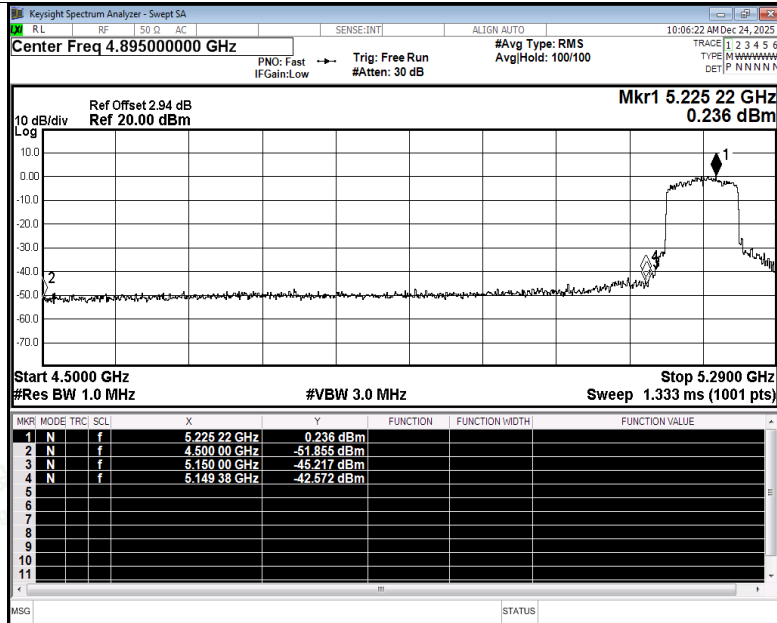

Restrict Band NVNT ac80 5210MHz Ant3 Peak

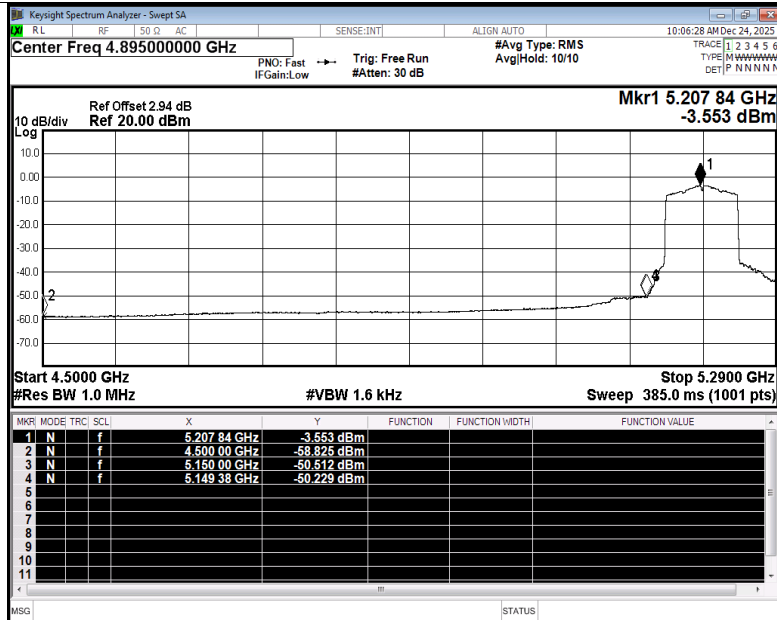

Restrict Band NVNT ac80 5210MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

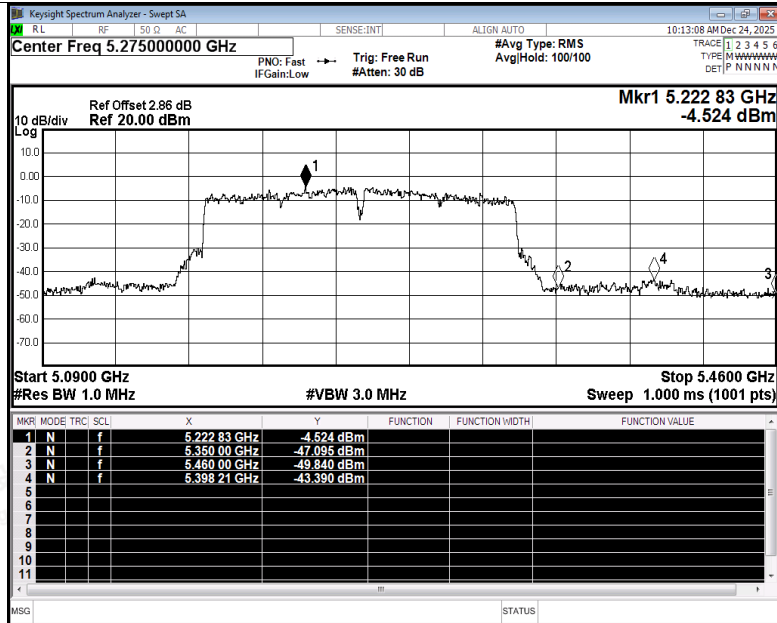

Restrict Band NVNT ac160 5250MHz Ant3 Peak

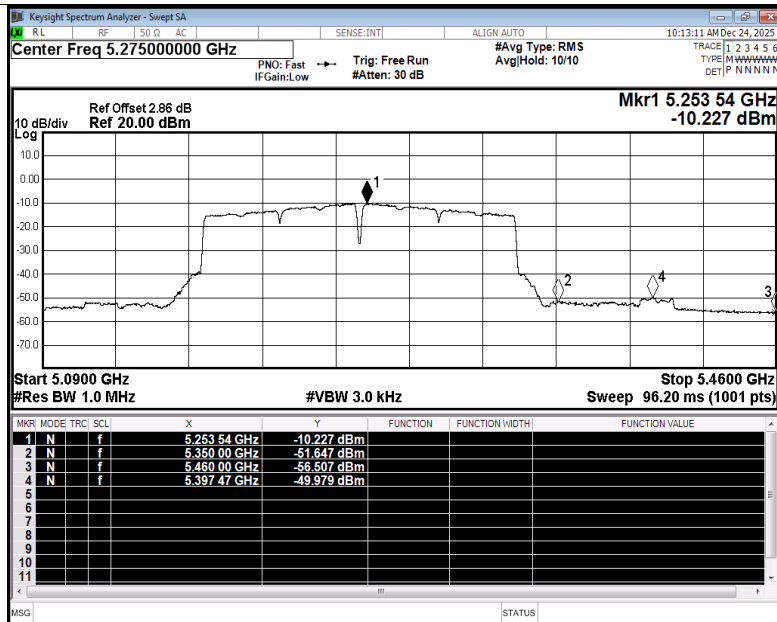

Restrict Band NVNT ac160 5250MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

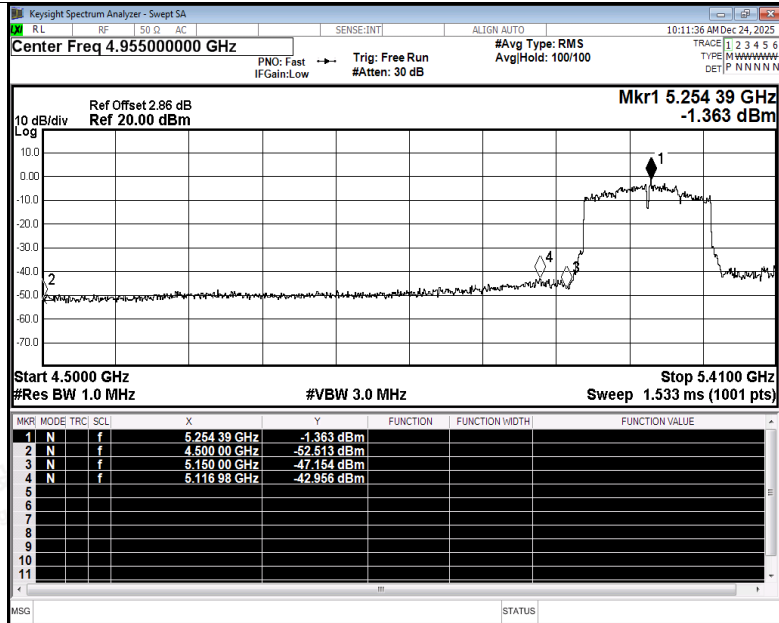

Restrict Band NVNT ac160 5250MHz Ant3 Peak

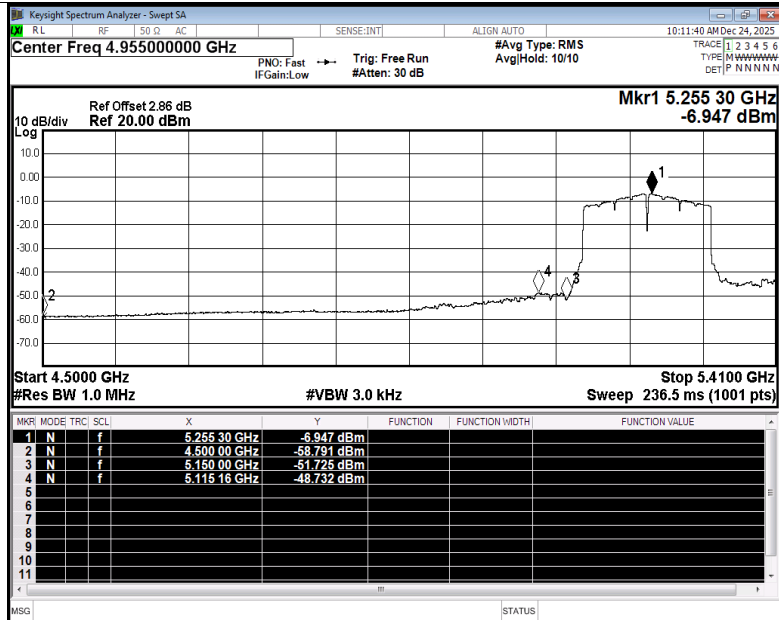

Restrict Band NVNT ac160 5250MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

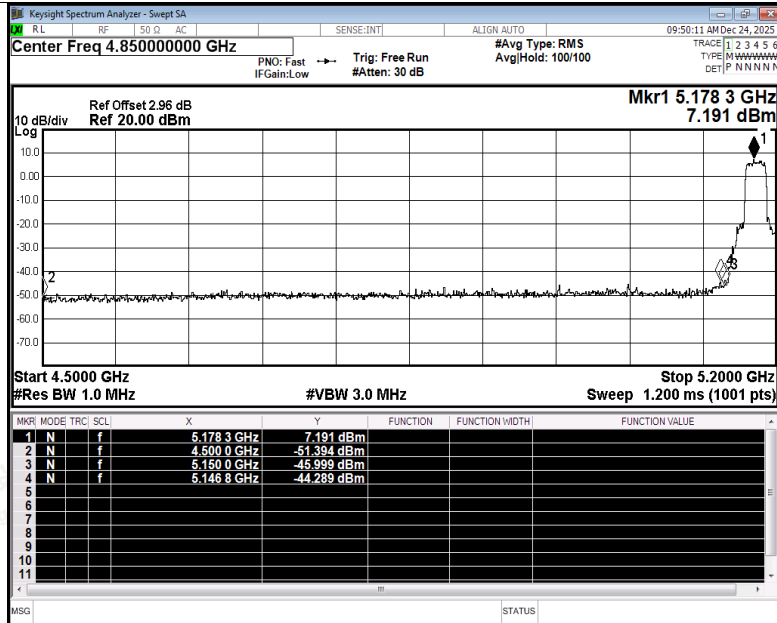

Restrict Band NVNT ax20 5180MHz Ant3 Peak

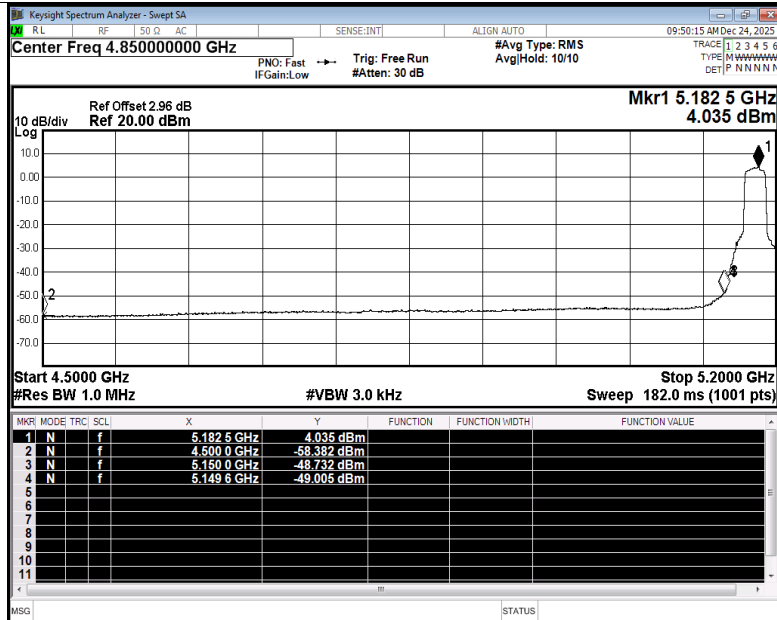

Restrict Band NVNT ax20 5180MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

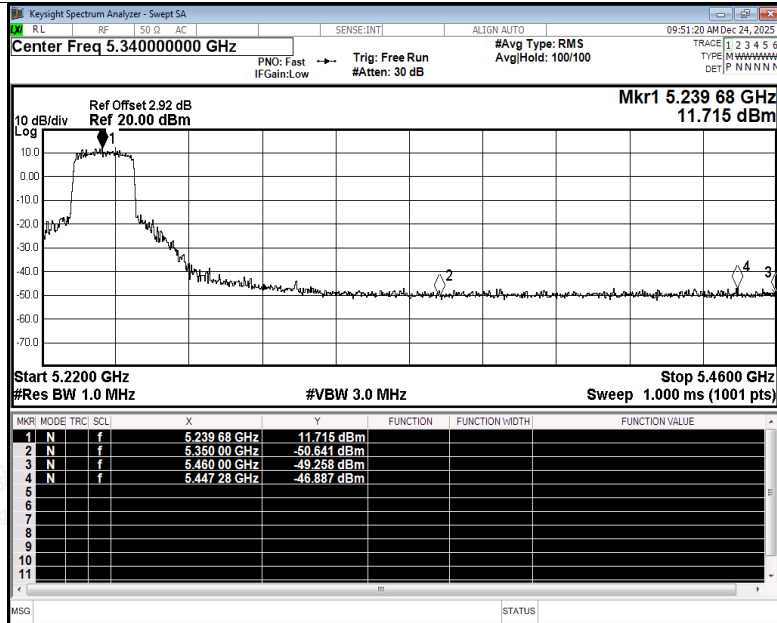

Restrict Band NVNT ax20 5240MHz Ant3 Peak

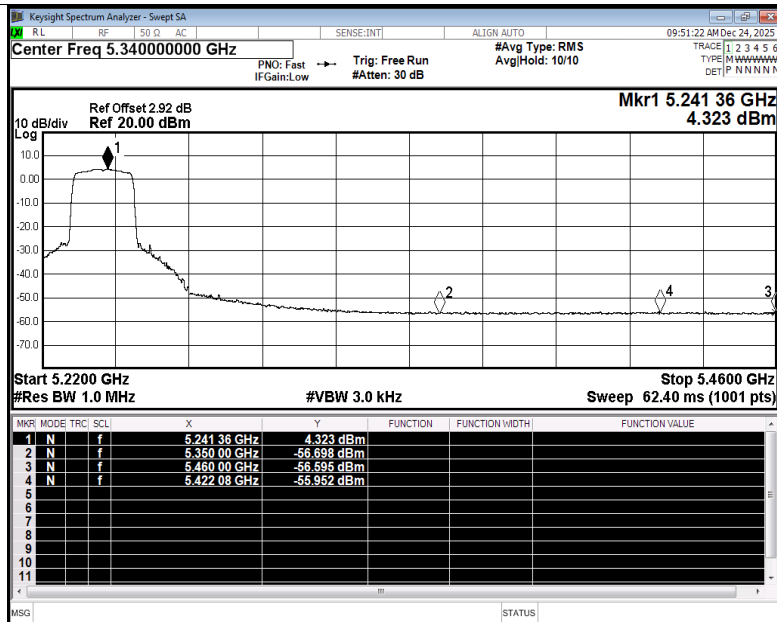

Restrict Band NVNT ax20 5240MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

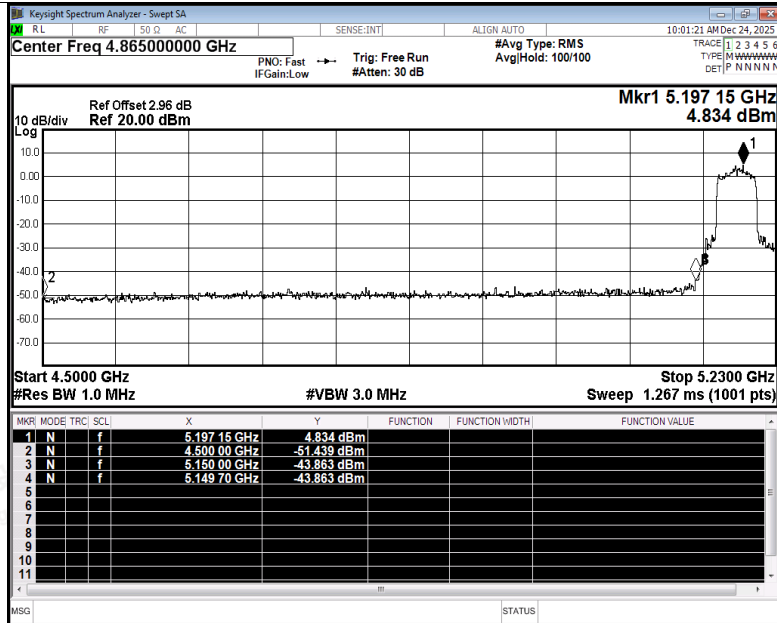

Restrict Band NVNT ax40 5190MHz Ant3 Peak

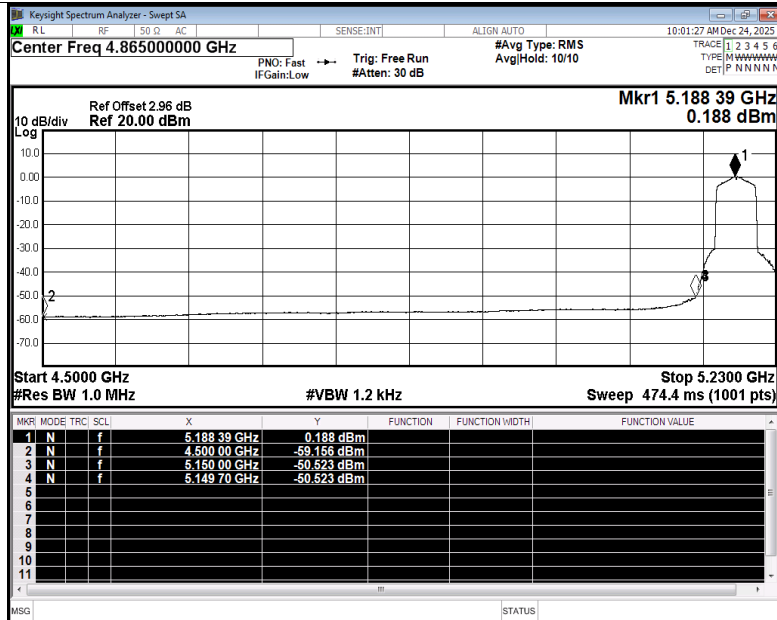

Restrict Band NVNT ax40 5190MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

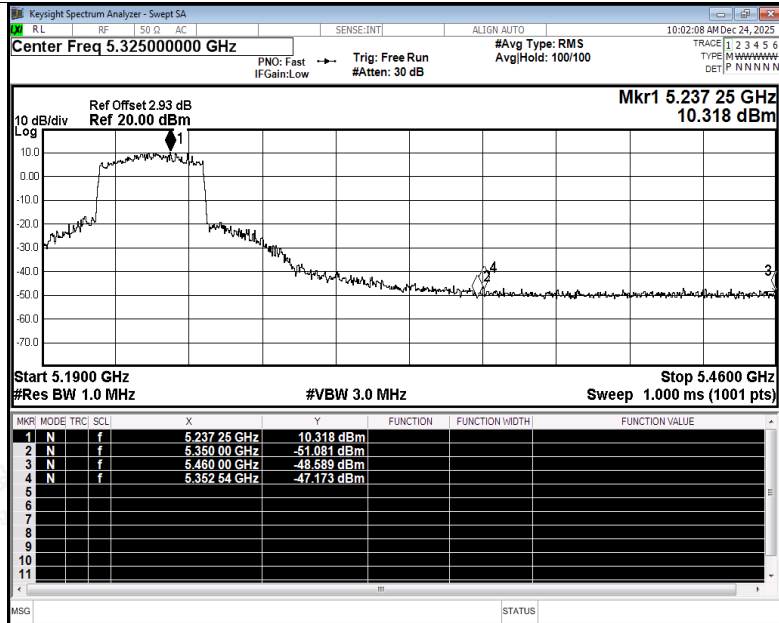

Restrict Band NVNT ax40 5230MHz Ant3 Peak

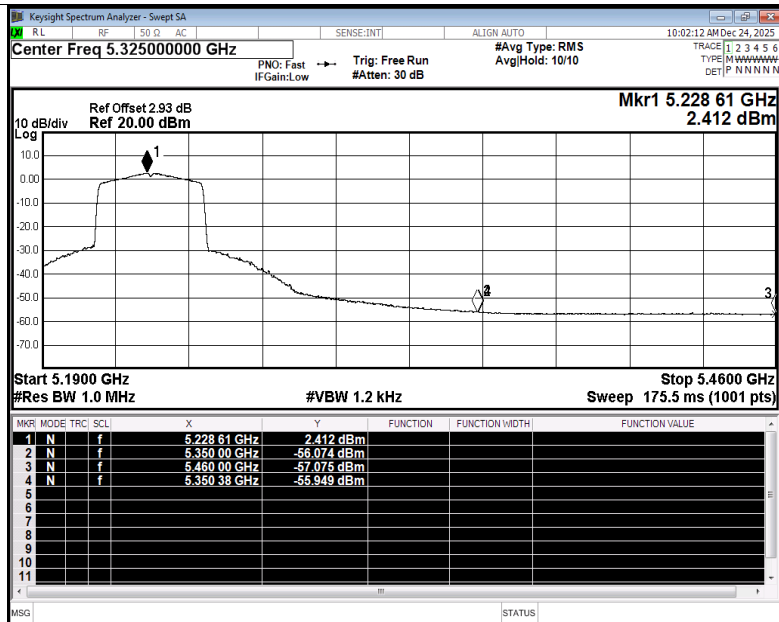

Restrict Band NVNT ax40 5230MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

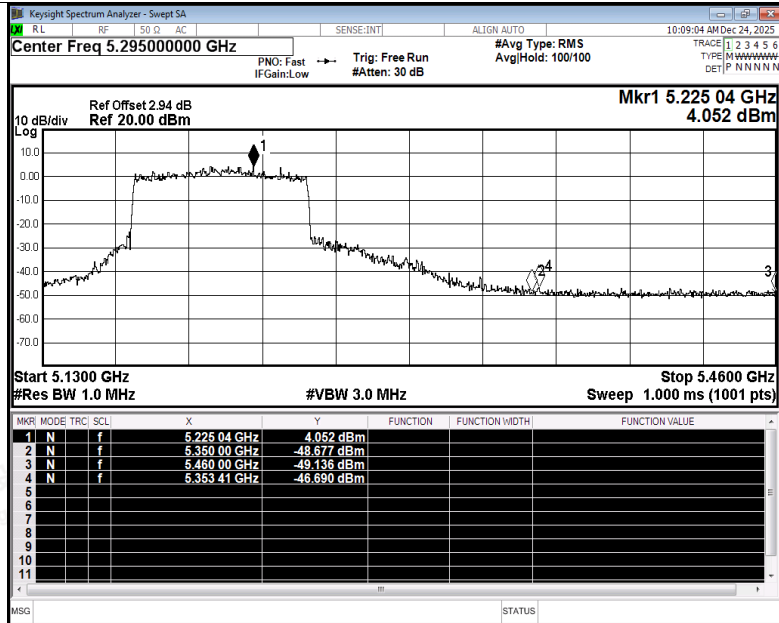


Restrict Band NVNT ax80 5210MHz Ant3 Peak

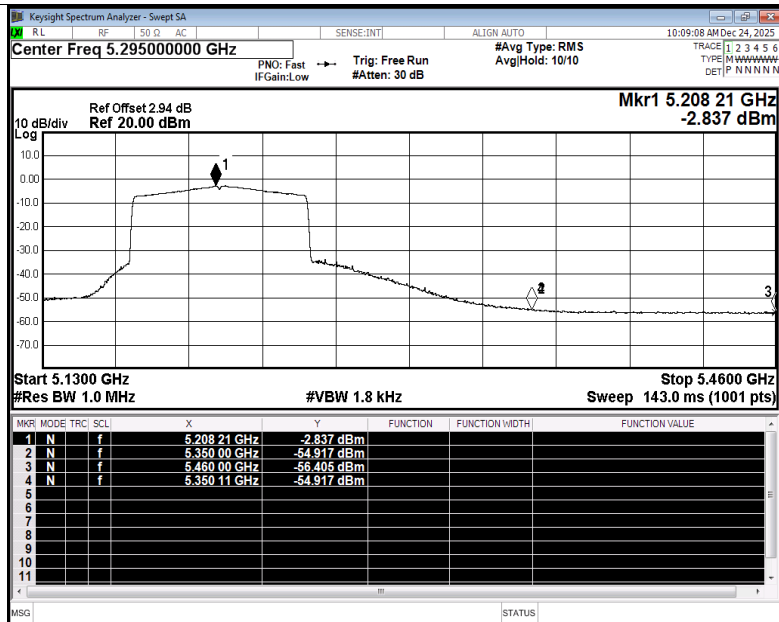


Restrict Band NVNT ax80 5210MHz Ant3 Average



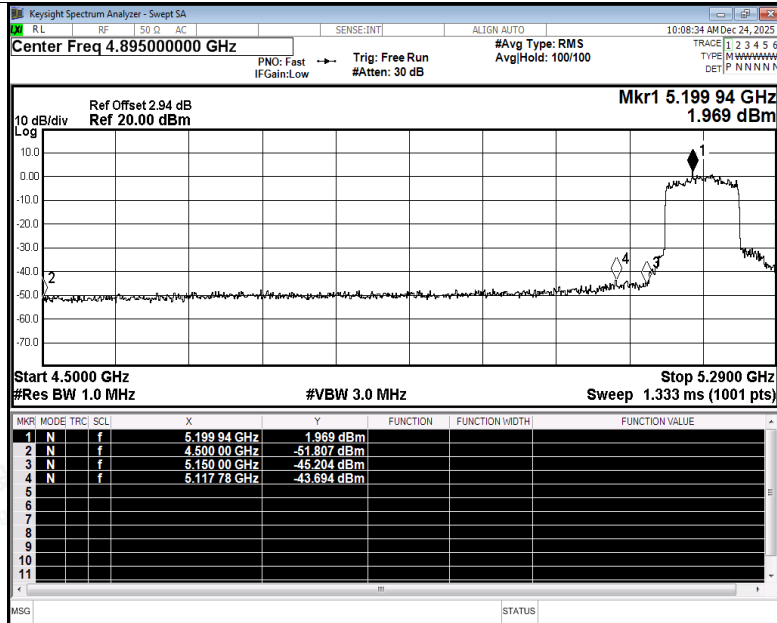

Restrict Band NVNT ax80 5210MHz Ant3 Peak

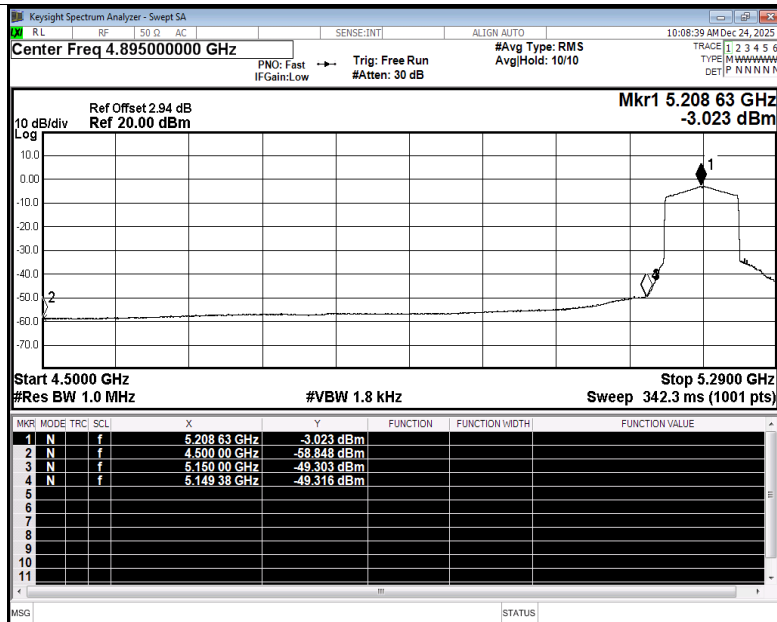

Restrict Band NVNT ax80 5210MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

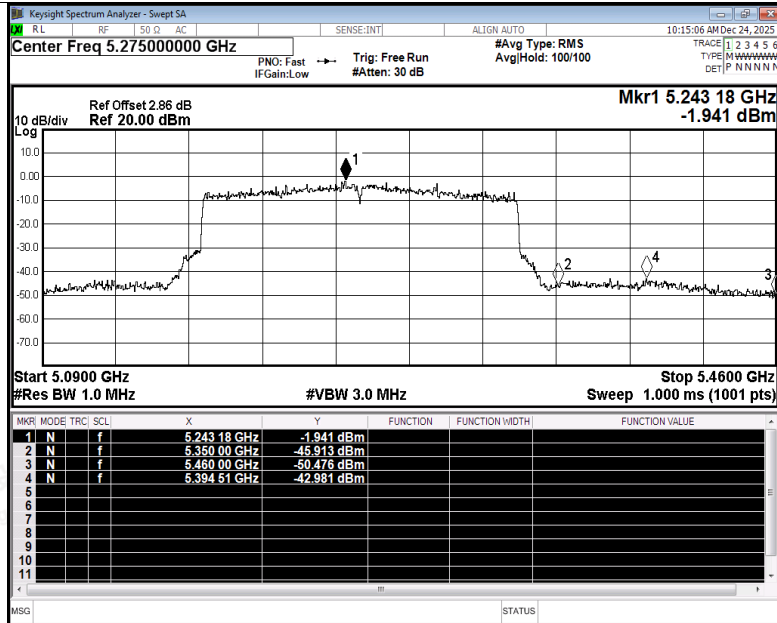

Restrict Band NVNT ax160 5250MHz Ant3 Peak

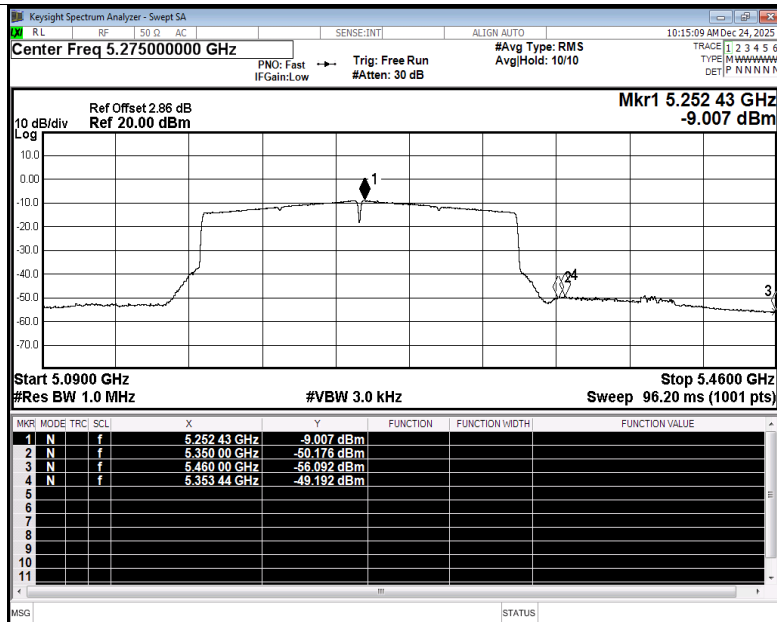

Restrict Band NVNT ax160 5250MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

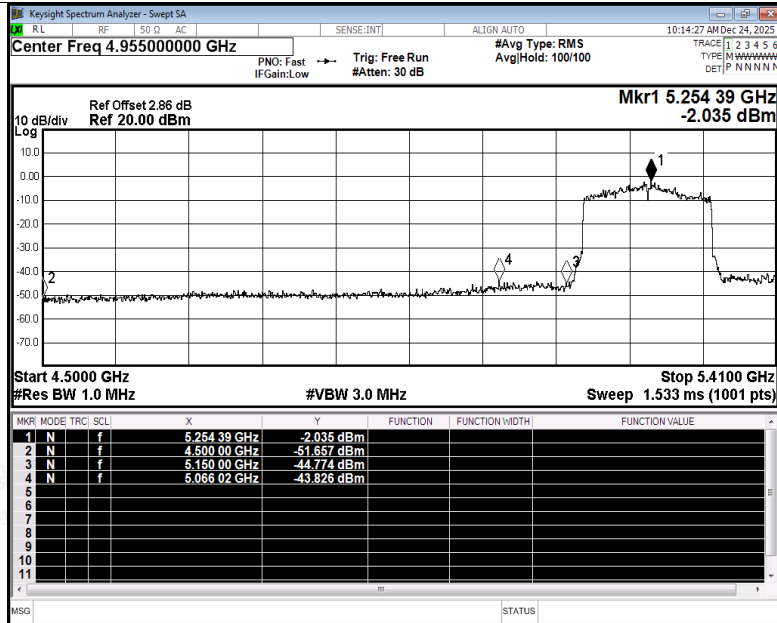

Restrict Band NVNT ax160 5250MHz Ant3 Peak

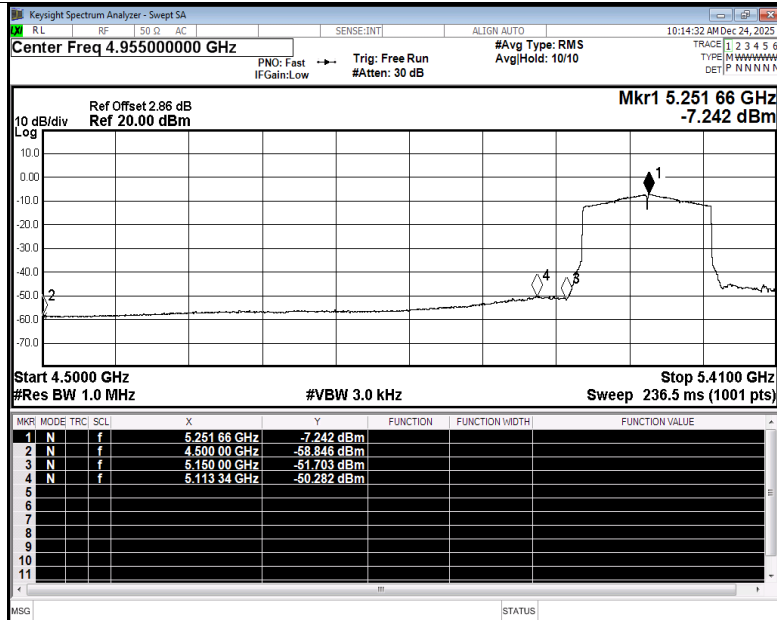

Restrict Band NVNT ax160 5250MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

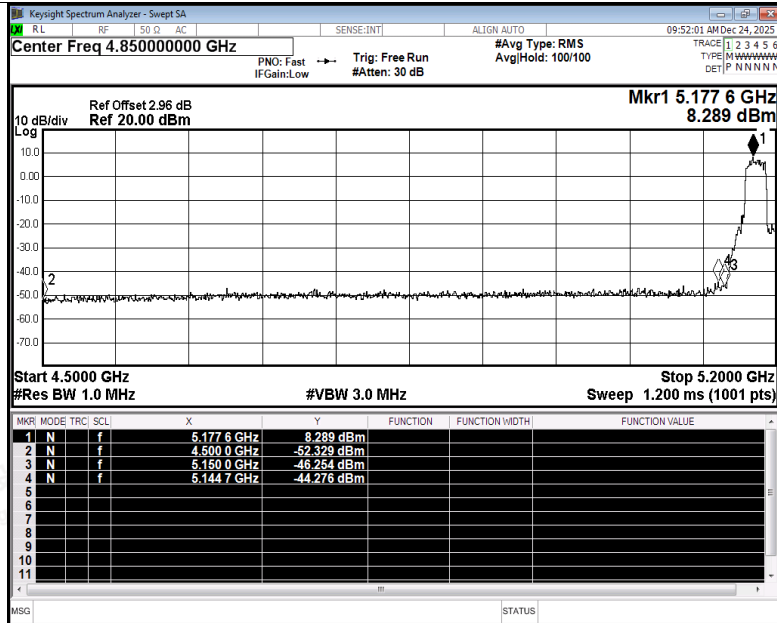

Restrict Band NVNT be20 5180MHz Ant3 Peak

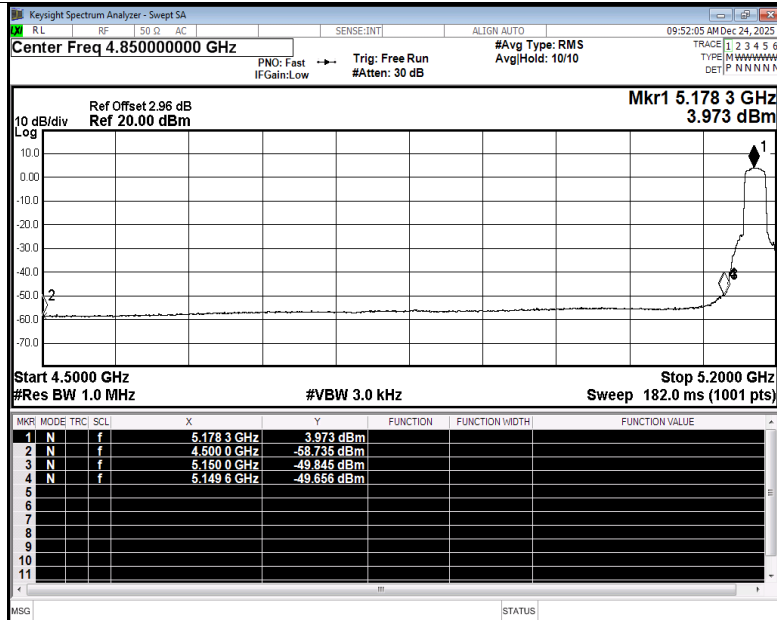

Restrict Band NVNT be20 5180MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

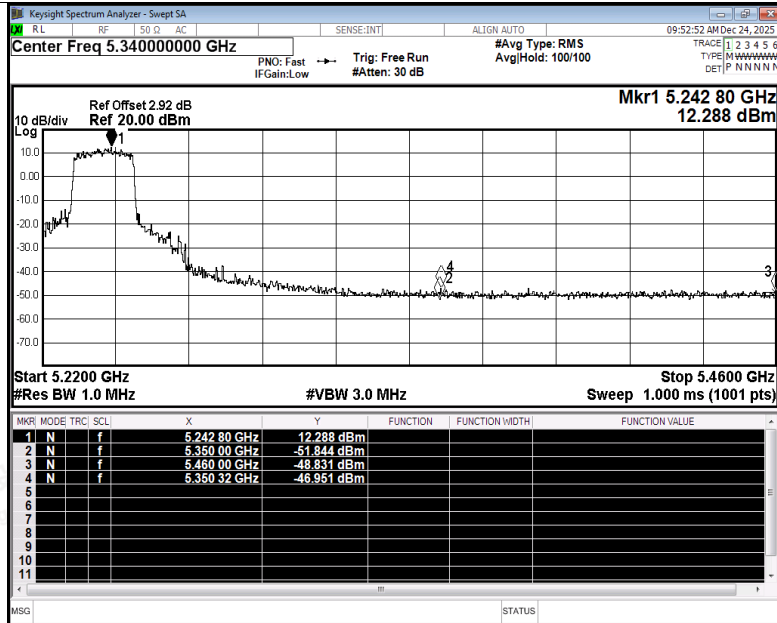

Restrict Band NVNT be20 5240MHz Ant3 Peak

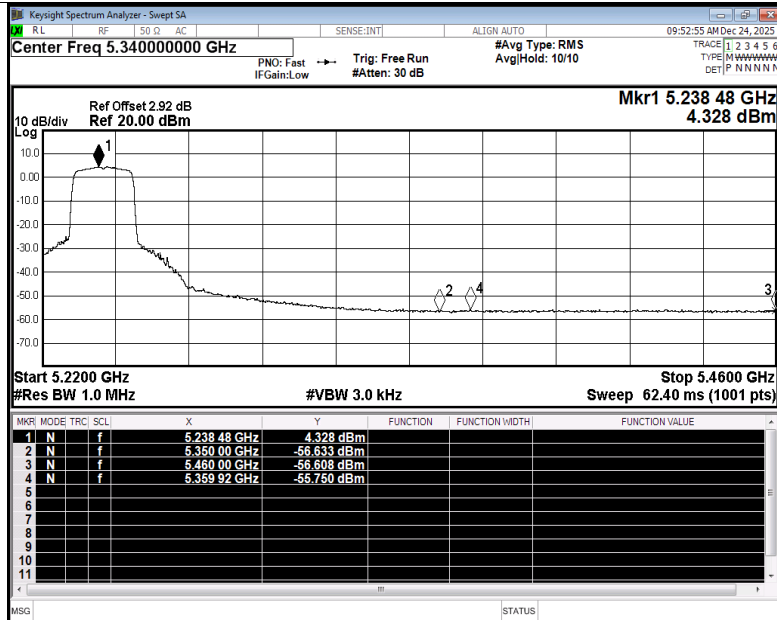

Restrict Band NVNT be20 5240MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

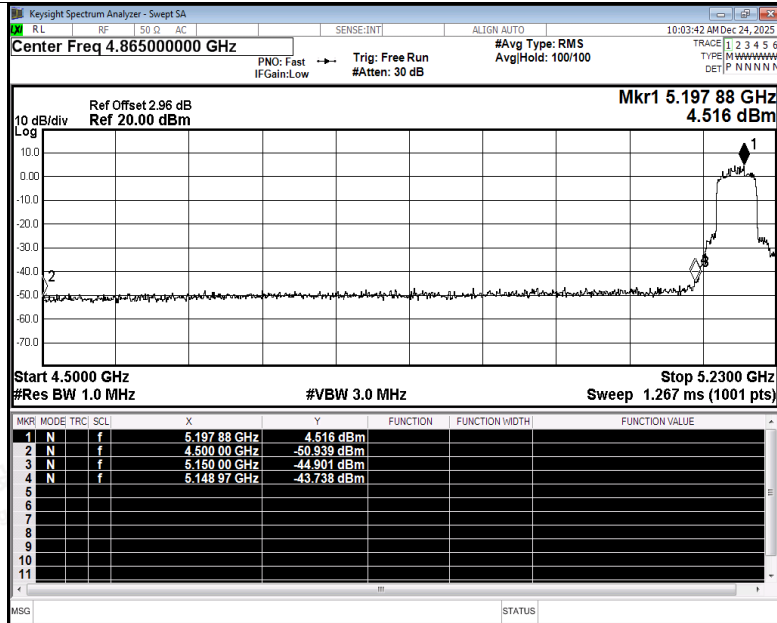


Restrict Band NVNT be40 5190MHz Ant3 Peak

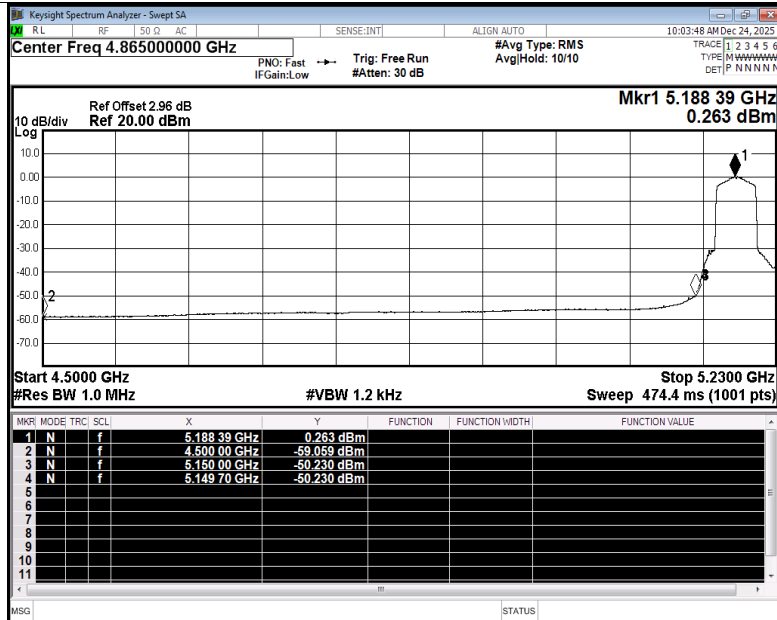


Restrict Band NVNT be40 5190MHz Ant3 Average



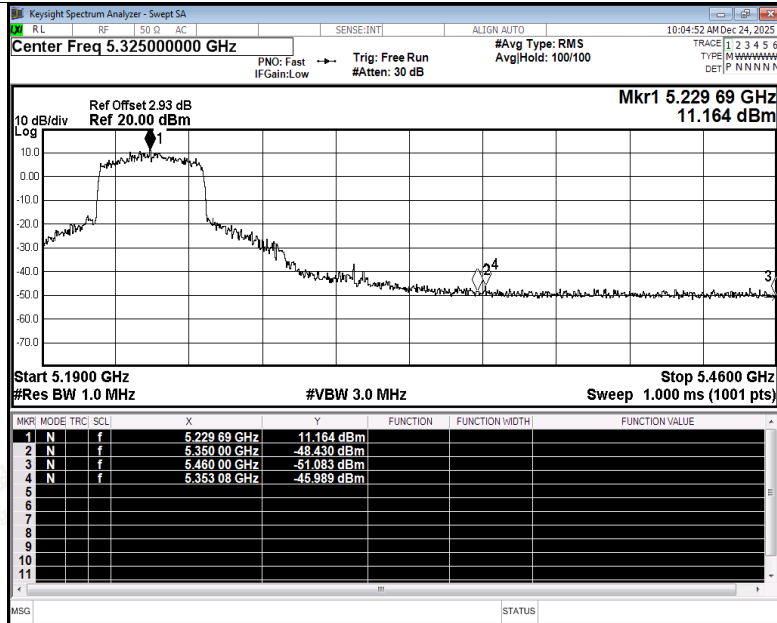


Restrict Band NVNT be40 5230MHz Ant3 Peak

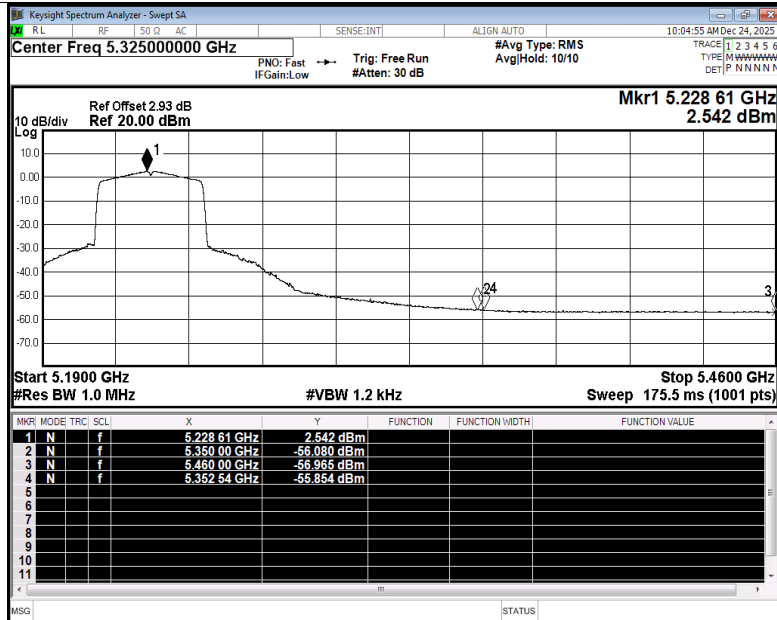


Restrict Band NVNT be40 5230MHz Ant3 Average



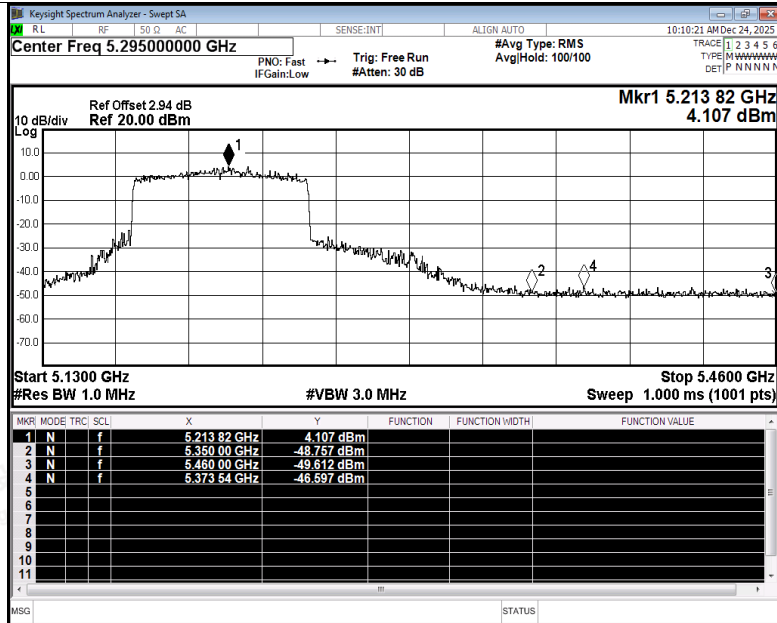


Restrict Band NVNT be80 5210MHz Ant3 Peak

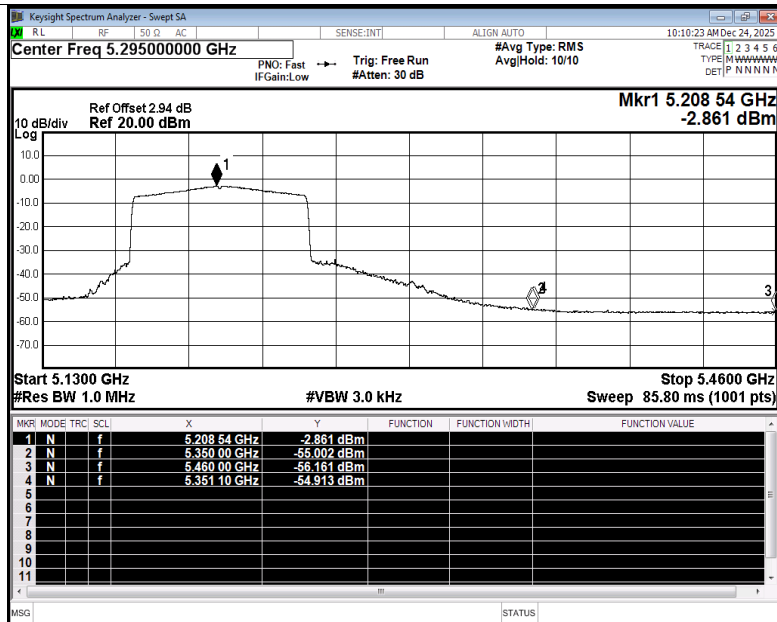


Restrict Band NVNT be80 5210MHz Ant3 Average



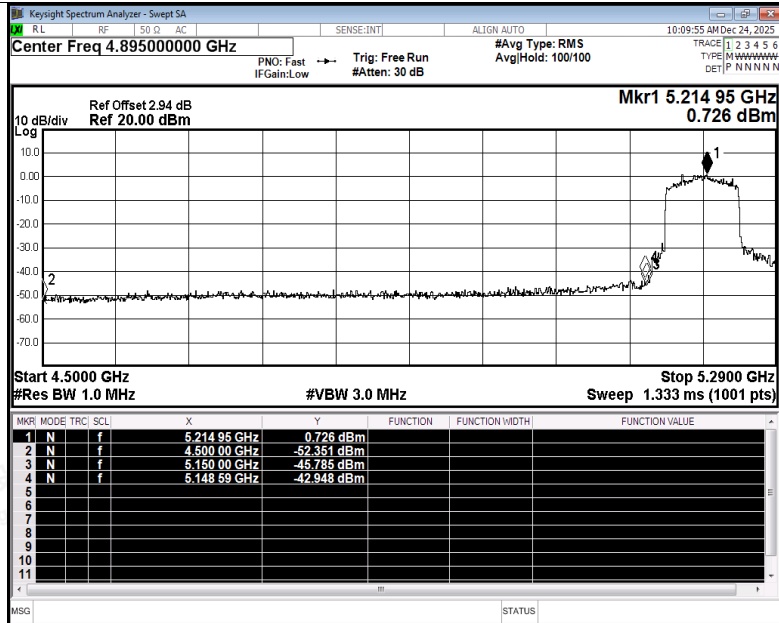


Restrict Band NVNT be80 5210MHz Ant3 Peak

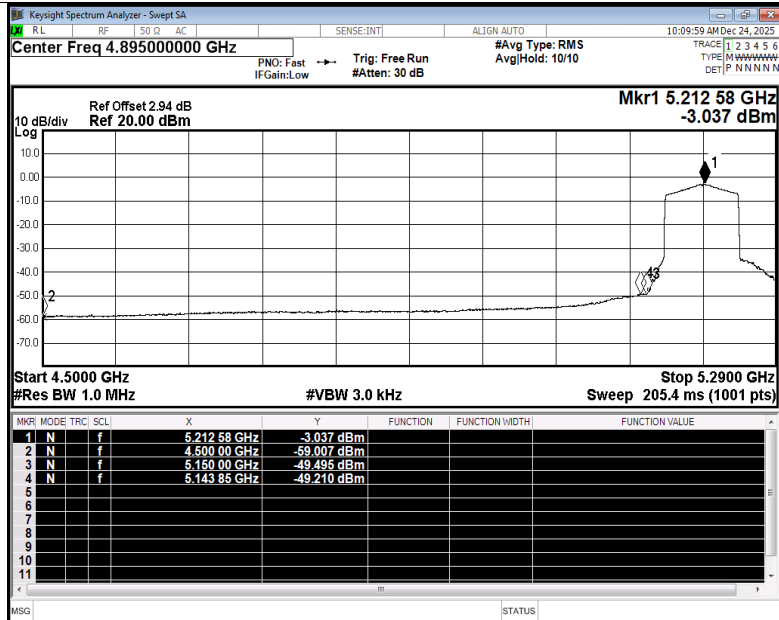


Restrict Band NVNT be80 5210MHz Ant3 Average



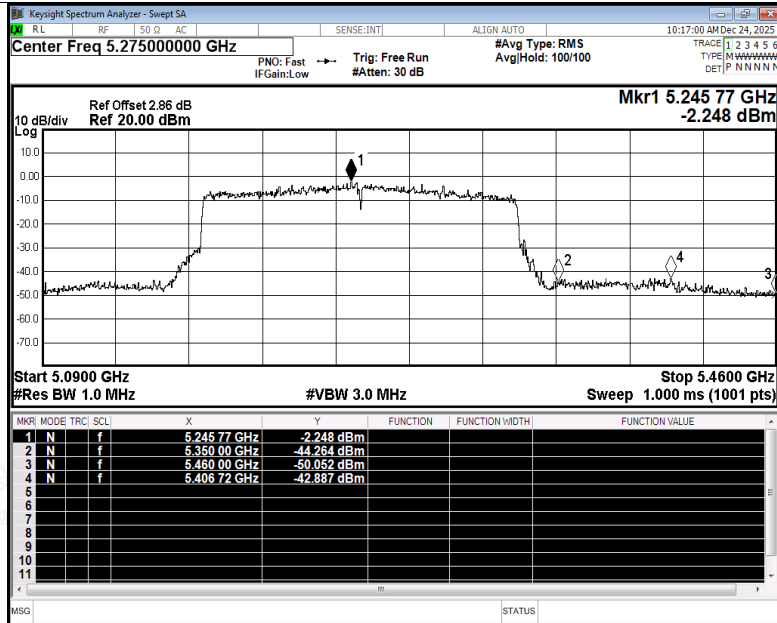

Restrict Band NVNT be160 5250MHz Ant3 Peak

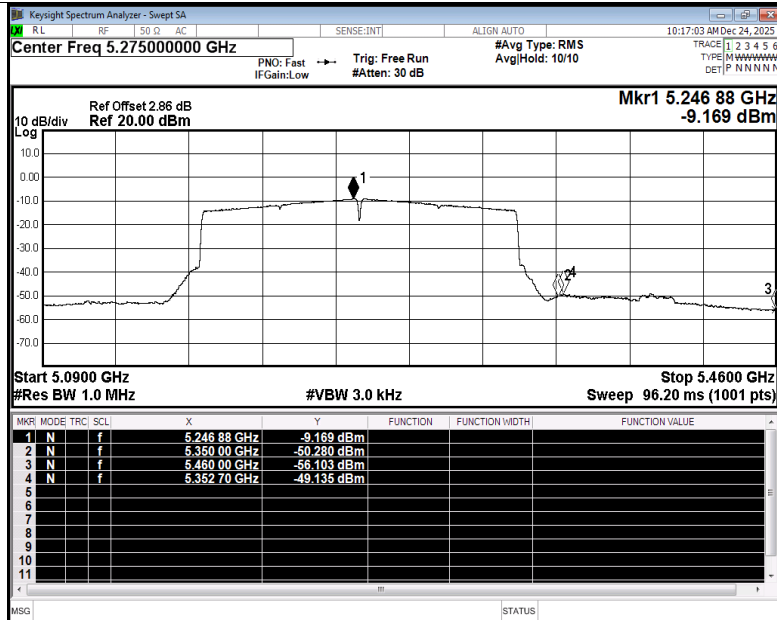

Restrict Band NVNT be160 5250MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

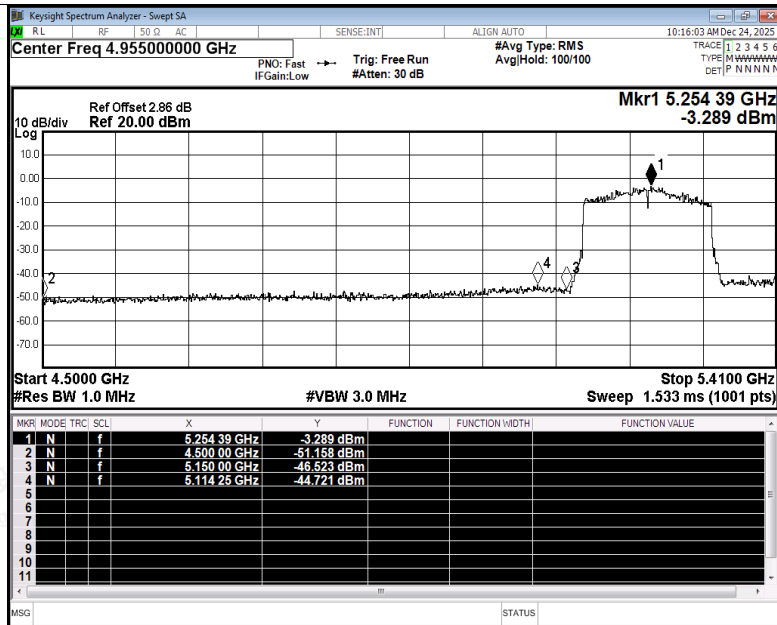

Restrict Band NVNT be160 5250MHz Ant3 Peak

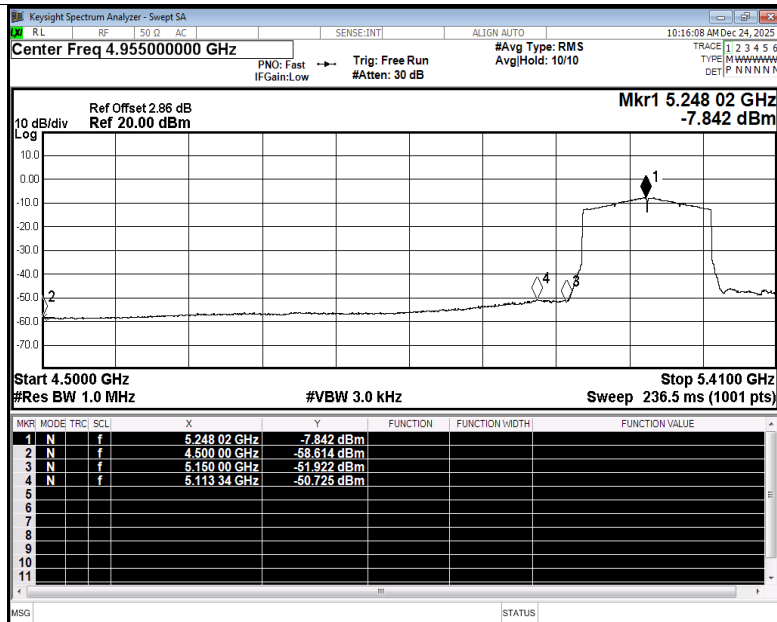

Restrict Band NVNT be160 5250MHz Ant3 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant4	4500	-61.22	6.49	40.5	Peak	68.2	Pass
NVNT	a	5180	Ant4	4500	-68.38	6.49	33.34	Average	54	Pass
NVNT	a	5180	Ant4	5147.5	-46.48	6.49	55.24	Peak	68.2	Pass
NVNT	a	5180	Ant4	5149.6	-49.04	6.49	52.68	Average	54	Pass
NVNT	a	5180	Ant4	5150	-46.53	6.49	55.19	Peak	68.2	Pass
NVNT	a	5180	Ant4	5150	-48.9	6.49	52.82	Average	54	Pass
NVNT	a	5240	Ant4	5350	-49.16	6.49	52.56	Peak	68.2	Pass
NVNT	a	5240	Ant4	5350	-56.58	6.49	45.14	Average	54	Pass
NVNT	a	5240	Ant4	5446.56	-46.32	6.49	55.4	Peak	68.2	Pass
NVNT	a	5240	Ant4	5441.76	-56.28	6.49	45.44	Average	54	Pass
NVNT	a	5240	Ant4	5460	-49.64	6.49	52.08	Peak	68.2	Pass
NVNT	a	5240	Ant4	5460	-56.87	6.49	44.85	Average	54	Pass
NVNT	n20	5180	Ant4	4500	-52.36	6.49	49.36	Peak	68.2	Pass
NVNT	n20	5180	Ant4	4500	-58.93	6.49	42.79	Average	54	Pass
NVNT	n20	5180	Ant4	5147.5	-45.17	6.49	56.55	Peak	68.2	Pass
NVNT	n20	5180	Ant4	5149.6	-50.38	6.49	51.34	Average	54	Pass
NVNT	n20	5180	Ant4	5150	-42.97	6.49	58.75	Peak	68.2	Pass
NVNT	n20	5180	Ant4	5150	-50.28	6.49	51.44	Average	54	Pass
NVNT	n20	5240	Ant4	5350	-49.13	6.49	52.59	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5350	-56.37	6.49	45.35	Average	54	Pass
NVNT	n20	5240	Ant4	5375.04	-47.13	6.49	54.59	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5424	-56.05	6.49	45.67	Average	54	Pass
NVNT	n20	5240	Ant4	5460	-49.39	6.49	52.33	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5460	-56.72	6.49	45	Average	54	Pass
NVNT	n40	5190	Ant4	4500	-61.66	6.49	40.06	Peak	68.2	Pass
NVNT	n40	5190	Ant4	4500	-68.46	6.49	33.26	Average	54	Pass
NVNT	n40	5190	Ant4	5148.24	-46.11	6.49	55.61	Peak	68.2	Pass
NVNT	n40	5190	Ant4	5149.7	-49.94	6.49	51.78	Average	54	Pass
NVNT	n40	5190	Ant4	5150	-46.58	6.49	55.14	Peak	68.2	Pass
NVNT	n40	5190	Ant4	5150	-49.25	6.49	52.47	Average	54	Pass
NVNT	n40	5230	Ant4	5350	-49.12	6.49	52.6	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5350	-55.36	6.49	46.36	Average	54	Pass
NVNT	n40	5230	Ant4	5381.7	-45.99	6.49	55.73	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5350.11	-55.36	6.49	46.36	Average	54	Pass
NVNT	n40	5230	Ant4	5460	-48.39	6.49	53.33	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5460	-56.88	6.49	44.84	Average	54	Pass
NVNT	ac20	5180	Ant4	4500	-51.51	6.49	50.21	Peak	68.2	Pass
NVNT	ac20	5180	Ant4	4500	-58.63	6.49	43.09	Average	54	Pass
NVNT	ac20	5180	Ant4	5148.9	-46.13	6.49	55.59	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant4	5149.6	-49.3	6.49	52.42	Average	54	Pass
NVNT	ac20	5180	Ant4	5150	-43.64	6.49	58.08	Peak	68.2	Pass
NVNT	ac20	5180	Ant4	5150	-49.18	6.49	52.54	Average	54	Pass
NVNT	ac20	5240	Ant4	5350	-49.87	6.49	51.85	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5350	-56.59	6.49	45.13	Average	54	Pass
NVNT	ac20	5240	Ant4	5435.52	-46.7	6.49	55.02	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5419.92	-55.81	6.49	45.91	Average	54	Pass
NVNT	ac20	5240	Ant4	5460	-50.81	6.49	50.91	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5460	-56.55	6.49	45.17	Average	54	Pass
NVNT	ac40	5190	Ant4	4500	-51.67	6.49	50.05	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	4500	-58.9	6.49	42.82	Average	54	Pass
NVNT	ac40	5190	Ant4	5148.97	-42.89	6.49	58.83	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	5148.24	-48.75	6.49	52.97	Average	54	Pass
NVNT	ac40	5190	Ant4	5150	-44.35	6.49	57.37	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	5150	-48.62	6.49	53.1	Average	54	Pass
NVNT	ac40	5230	Ant4	5350	-46.84	6.49	54.88	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5350	-56.11	6.49	45.61	Average	54	Pass
NVNT	ac40	5230	Ant4	5432.46	-46.61	6.49	55.11	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5351.73	-56	6.49	45.72	Average	54	Pass
NVNT	ac40	5230	Ant4	5460	-49.78	6.49	51.94	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5460	-56.88	6.49	44.84	Average	54	Pass
NVNT	ac80	5210	Ant4	5350	-48.35	6.49	53.37	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5350	-54.8	6.49	46.92	Average	54	Pass
NVNT	ac80	5210	Ant4	5352.09	-44.35	6.49	57.37	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5355.06	-53.93	6.49	47.79	Average	54	Pass
NVNT	ac80	5210	Ant4	5460	-50.6	6.49	51.12	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5460	-56.37	6.49	45.35	Average	54	Pass
NVNT	ac80	5210	Ant4	4500	-51.66	6.49	50.06	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	4500	-58.9	6.49	42.82	Average	54	Pass
NVNT	ac80	5210	Ant4	5125.68	-44.45	6.49	57.27	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5138.32	-50.46	6.49	51.26	Average	54	Pass
NVNT	ac80	5210	Ant4	5150	-43.33	6.49	58.39	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5150	-50.37	6.49	51.35	Average	54	Pass
NVNT	ac160	5250	Ant4	5350	-49.18	6.49	52.54	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	5350	-53.95	6.49	47.77	Average	54	Pass
NVNT	ac160	5250	Ant4	5403.02	-44.35	6.49	57.37	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	5397.47	-50.68	6.49	51.04	Average	54	Pass
NVNT	ac160	5250	Ant4	5460	-49.62	6.49	52.1	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	5460	-56.66	6.49	45.06	Average	54	Pass
NVNT	ac160	5250	Ant4	4500	-50.84	6.49	50.88	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	4500	-58.77	6.49	42.95	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac160	5250	Ant4	5123.35	-42.93	6.49	58.79	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	5123.35	-49.73	6.49	51.99	Average	54	Pass
NVNT	ac160	5250	Ant4	5150	-49.32	6.49	52.4	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	5150	-52.54	6.49	49.18	Average	54	Pass
NVNT	ax20	5180	Ant4	4500	-50.92	6.49	50.8	Peak	68.2	Pass
NVNT	ax20	5180	Ant4	4500	-58.79	6.49	42.93	Average	54	Pass
NVNT	ax20	5180	Ant4	5149.6	-45.41	6.49	56.31	Peak	68.2	Pass
NVNT	ax20	5180	Ant4	5149.6	-49.12	6.49	52.6	Average	54	Pass
NVNT	ax20	5180	Ant4	5150	-46.76	6.49	54.96	Peak	68.2	Pass
NVNT	ax20	5180	Ant4	5150	-49.31	6.49	52.41	Average	54	Pass
NVNT	ax20	5240	Ant4	5350	-49.47	6.49	52.25	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5350	-56.31	6.49	45.41	Average	54	Pass
NVNT	ax20	5240	Ant4	5375.28	-47.37	6.49	54.35	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5386.8	-55.69	6.49	46.03	Average	54	Pass
NVNT	ax20	5240	Ant4	5460	-48.82	6.49	52.9	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5460	-56.56	6.49	45.16	Average	54	Pass
NVNT	ax40	5190	Ant4	4500	-52.94	6.49	48.78	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	4500	-58.31	6.49	43.41	Average	54	Pass
NVNT	ax40	5190	Ant4	5148.24	-43.73	6.49	57.99	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	5149.7	-50.17	6.49	51.55	Average	54	Pass
NVNT	ax40	5190	Ant4	5150	-47.59	6.49	54.13	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	5150	-49.7	6.49	52.02	Average	54	Pass
NVNT	ax40	5230	Ant4	5350	-47.73	6.49	53.99	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5350	-55.99	6.49	45.73	Average	54	Pass
NVNT	ax40	5230	Ant4	5390.34	-46.77	6.49	54.95	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5353.08	-55.54	6.49	46.18	Average	54	Pass
NVNT	ax40	5230	Ant4	5460	-50.8	6.49	50.92	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5460	-56.39	6.49	45.33	Average	54	Pass
NVNT	ax80	5210	Ant4	5350	-48.57	6.49	53.15	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5350	-54.39	6.49	47.33	Average	54	Pass
NVNT	ax80	5210	Ant4	5352.75	-46.62	6.49	55.1	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5352.09	-53.83	6.49	47.89	Average	54	Pass
NVNT	ax80	5210	Ant4	5460	-50.14	6.49	51.58	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5460	-56.23	6.49	45.49	Average	54	Pass
NVNT	ax80	5210	Ant4	4500	-52.1	6.49	49.62	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	4500	-58.37	6.49	43.35	Average	54	Pass
NVNT	ax80	5210	Ant4	5125.68	-45.15	6.49	56.57	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5149.38	-49.63	6.49	52.09	Average	54	Pass
NVNT	ax80	5210	Ant4	5150	-45.62	6.49	56.1	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5150	-49.73	6.49	51.99	Average	54	Pass
NVNT	ax160	5250	Ant4	5350	-46.63	6.49	55.09	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax160	5250	Ant4	5350	-53.21	6.49	48.51	Average	54	Pass
NVNT	ax160	5250	Ant4	5408.57	-44.14	6.49	57.58	Peak	68.2	Pass
NVNT	ax160	5250	Ant4	5402.28	-51.08	6.49	50.64	Average	54	Pass
NVNT	ax160	5250	Ant4	5460	-49.39	6.49	52.33	Peak	68.2	Pass
NVNT	ax160	5250	Ant4	5460	-55.97	6.49	45.75	Average	54	Pass
NVNT	ax160	5250	Ant4	4500	-53.08	6.49	48.64	Peak	68.2	Pass
NVNT	ax160	5250	Ant4	4500	-58.81	6.49	42.91	Average	54	Pass
NVNT	ax160	5250	Ant4	5061.47	-44.59	6.49	57.13	Peak	68.2	Pass
NVNT	ax160	5250	Ant4	5113.34	-50.43	6.49	51.29	Average	54	Pass
NVNT	ax160	5250	Ant4	5150	-47.72	6.49	54	Peak	68.2	Pass
NVNT	ax160	5250	Ant4	5150	-51.66	6.49	50.06	Average	54	Pass
NVNT	be20	5180	Ant4	4500	-51.46	6.49	50.26	Peak	68.2	Pass
NVNT	be20	5180	Ant4	4500	-58.81	6.49	42.91	Average	54	Pass
NVNT	be20	5180	Ant4	5148.2	-43.94	6.49	57.78	Peak	68.2	Pass
NVNT	be20	5180	Ant4	5149.6	-49.43	6.49	52.29	Average	54	Pass
NVNT	be20	5180	Ant4	5150	-44.32	6.49	57.4	Peak	68.2	Pass
NVNT	be20	5180	Ant4	5150	-49.27	6.49	52.45	Average	54	Pass
NVNT	be20	5240	Ant4	5350	-50.67	6.49	51.05	Peak	68.2	Pass
NVNT	be20	5240	Ant4	5350	-56.76	6.49	44.96	Average	54	Pass
NVNT	be20	5240	Ant4	5425.2	-47.21	6.49	54.51	Peak	68.2	Pass
NVNT	be20	5240	Ant4	5438.4	-56.23	6.49	45.49	Average	54	Pass
NVNT	be20	5240	Ant4	5460	-51.51	6.49	50.21	Peak	68.2	Pass
NVNT	be20	5240	Ant4	5460	-56.68	6.49	45.04	Average	54	Pass
NVNT	be40	5190	Ant4	4500	-52.75	6.49	48.97	Peak	68.2	Pass
NVNT	be40	5190	Ant4	4500	-58.99	6.49	42.73	Average	54	Pass
NVNT	be40	5190	Ant4	5148.24	-43.81	6.49	57.91	Peak	68.2	Pass
NVNT	be40	5190	Ant4	5149.7	-49.75	6.49	51.97	Average	54	Pass
NVNT	be40	5190	Ant4	5150	-43.54	6.49	58.18	Peak	68.2	Pass
NVNT	be40	5190	Ant4	5150	-49.19	6.49	52.53	Average	54	Pass
NVNT	be40	5230	Ant4	5350	-50.32	6.49	51.4	Peak	68.2	Pass
NVNT	be40	5230	Ant4	5350	-56.33	6.49	45.39	Average	54	Pass
NVNT	be40	5230	Ant4	5448.66	-46.46	6.49	55.26	Peak	68.2	Pass
NVNT	be40	5230	Ant4	5377.11	-55.94	6.49	45.78	Average	54	Pass
NVNT	be40	5230	Ant4	5460	-49.65	6.49	52.07	Peak	68.2	Pass
NVNT	be40	5230	Ant4	5460	-56.84	6.49	44.88	Average	54	Pass
NVNT	be80	5210	Ant4	5350	-50.23	6.49	51.49	Peak	68.2	Pass
NVNT	be80	5210	Ant4	5350	-55.01	6.49	46.71	Average	54	Pass
NVNT	be80	5210	Ant4	5350.77	-45.98	6.49	55.74	Peak	68.2	Pass
NVNT	be80	5210	Ant4	5354.4	-54.93	6.49	46.79	Average	54	Pass
NVNT	be80	5210	Ant4	5460	-49.39	6.49	52.33	Peak	68.2	Pass
NVNT	be80	5210	Ant4	5460	-56.4	6.49	45.32	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	be80	5210	Ant4	4500	-52.48	6.49	49.24	Peak	68.2	Pass
NVNT	be80	5210	Ant4	4500	-59	6.49	42.72	Average	54	Pass
NVNT	be80	5210	Ant4	5127.26	-45.57	6.49	56.15	Peak	68.2	Pass
NVNT	be80	5210	Ant4	5148.59	-51.69	6.49	50.03	Average	54	Pass
NVNT	be80	5210	Ant4	5150	-49.57	6.49	52.15	Peak	68.2	Pass
NVNT	be80	5210	Ant4	5150	-51.17	6.49	50.55	Average	54	Pass
NVNT	be160	5250	Ant4	5350	-46.83	6.49	54.89	Peak	68.2	Pass
NVNT	be160	5250	Ant4	5350	-54.31	6.49	47.41	Average	54	Pass
NVNT	be160	5250	Ant4	5408.57	-44.13	6.49	57.59	Peak	68.2	Pass
NVNT	be160	5250	Ant4	5403.76	-51.71	6.49	50.01	Average	54	Pass
NVNT	be160	5250	Ant4	5460	-50.97	6.49	50.75	Peak	68.2	Pass
NVNT	be160	5250	Ant4	5460	-56.31	6.49	45.41	Average	54	Pass
NVNT	be160	5250	Ant4	4500	-51.95	6.49	49.77	Peak	68.2	Pass
NVNT	be160	5250	Ant4	4500	-58.65	6.49	43.07	Average	54	Pass
NVNT	be160	5250	Ant4	5122.44	-44.09	6.49	57.63	Peak	68.2	Pass
NVNT	be160	5250	Ant4	5116.98	-49.89	6.49	51.83	Average	54	Pass
NVNT	be160	5250	Ant4	5150	-48.92	6.49	52.8	Peak	68.2	Pass
NVNT	be160	5250	Ant4	5150	-51.77	6.49	49.95	Average	54	Pass



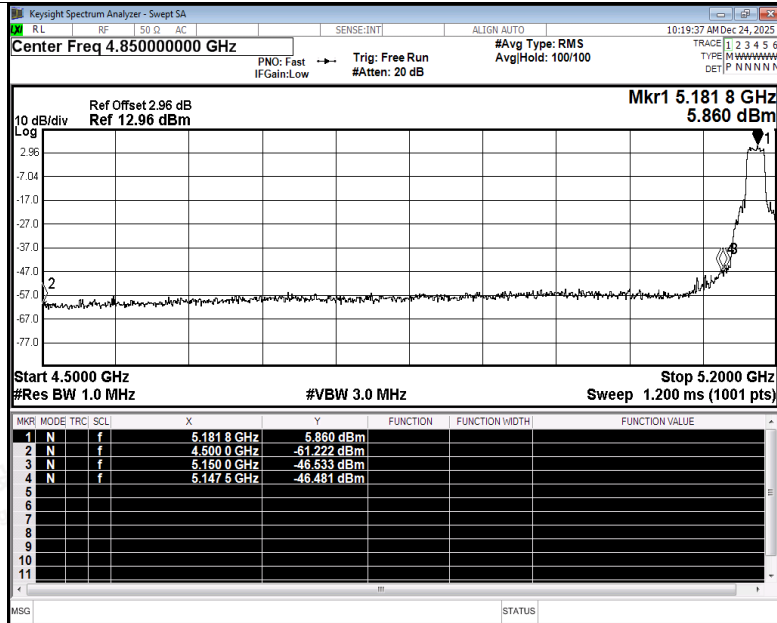

Restrict Band NVNT a 5180MHz Ant4 Peak

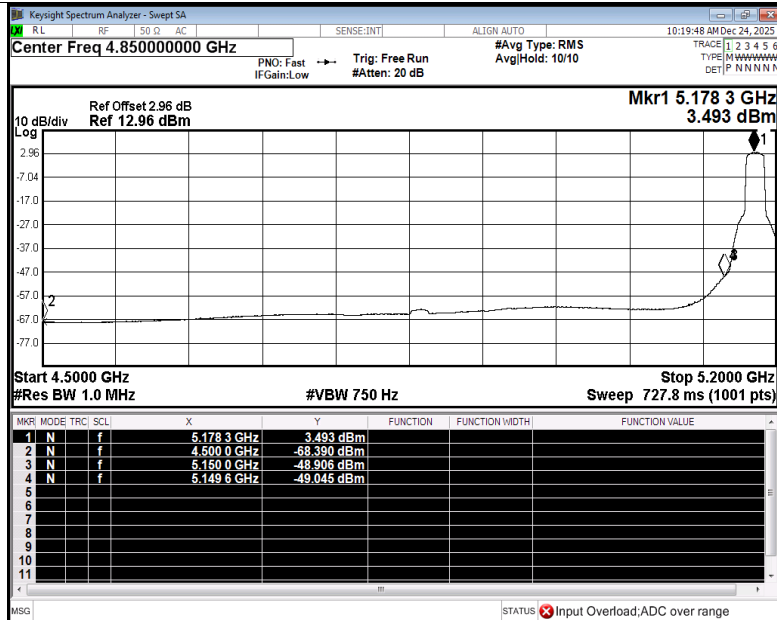

Restrict Band NVNT a 5180MHz Ant4 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

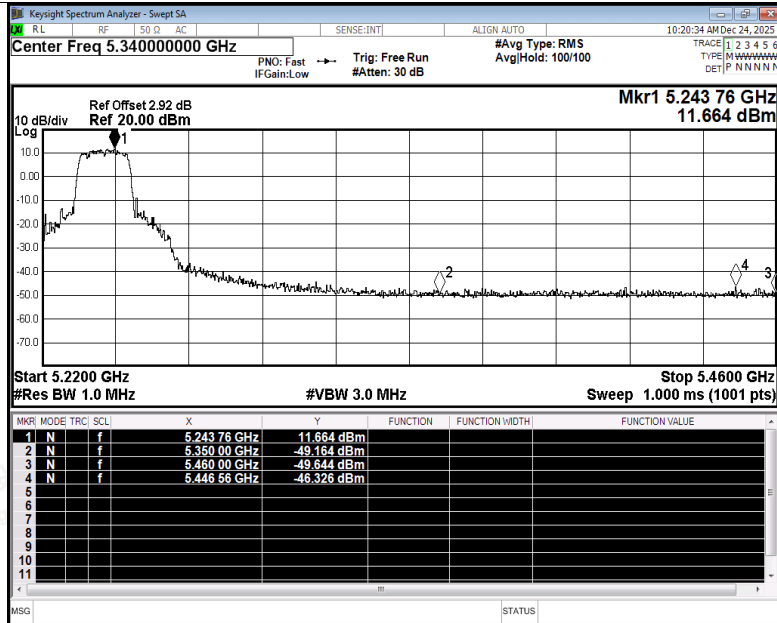


Restrict Band NVNT a 5240MHz Ant4 Peak

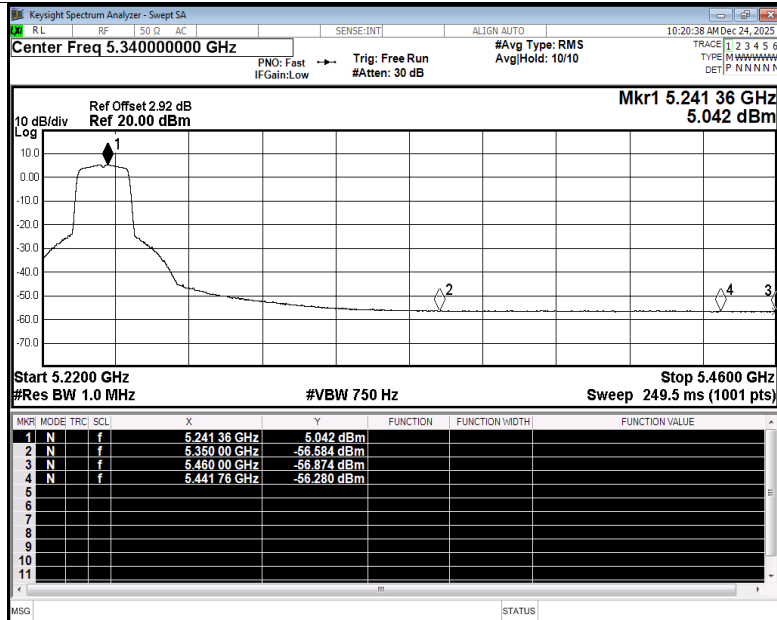


Restrict Band NVNT a 5240MHz Ant4 Average



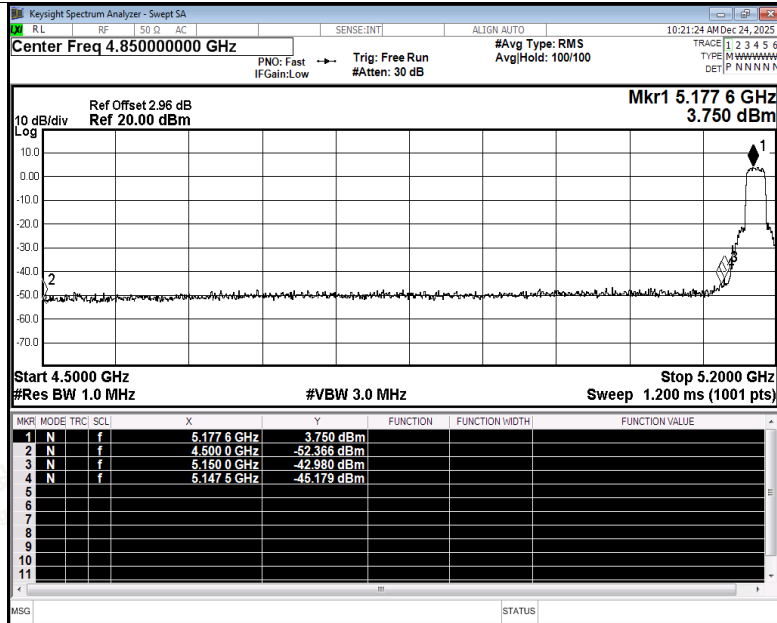


Restrict Band NVNT n20 5180MHz Ant4 Peak

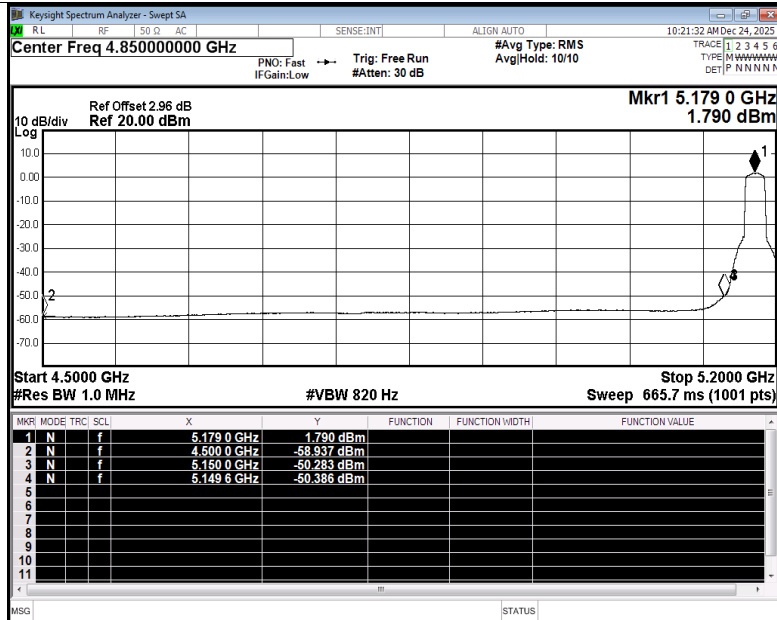


Restrict Band NVNT n20 5180MHz Ant4 Average



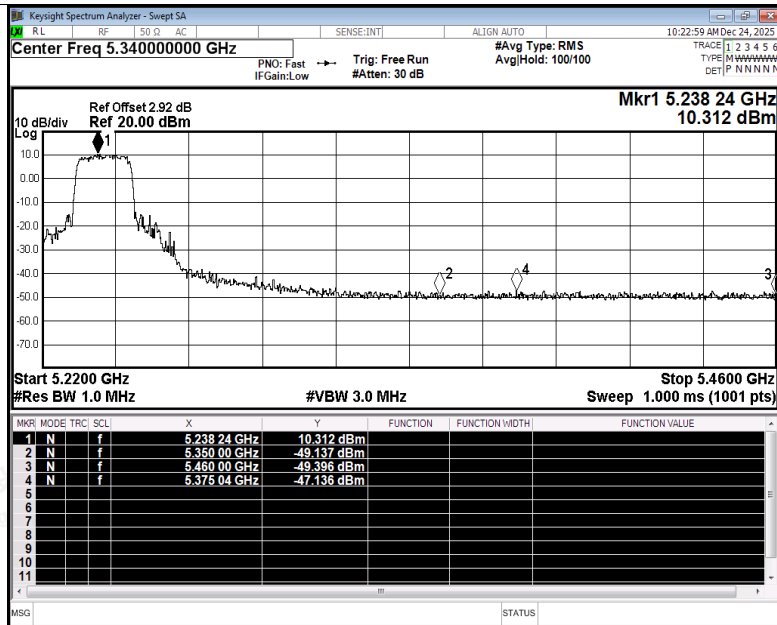


Restrict Band NVNT n20 5240MHz Ant4 Peak

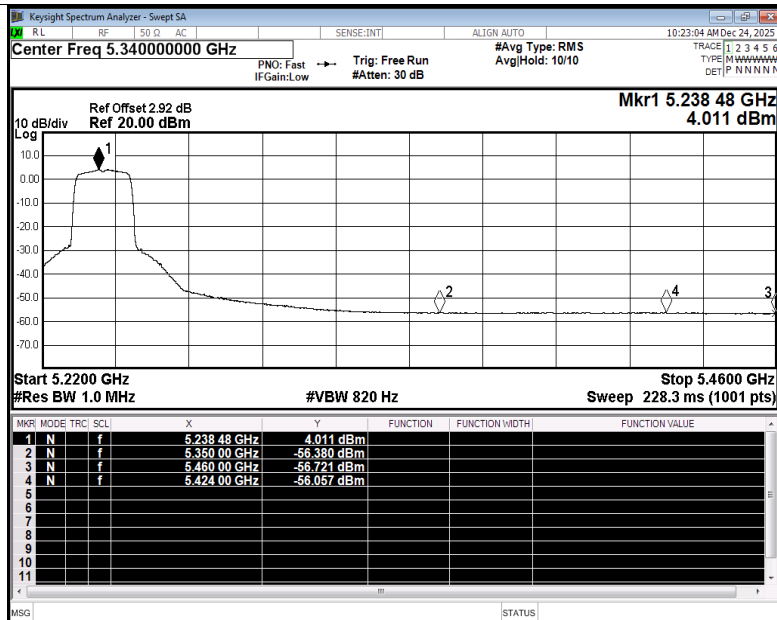


Restrict Band NVNT n20 5240MHz Ant4 Average



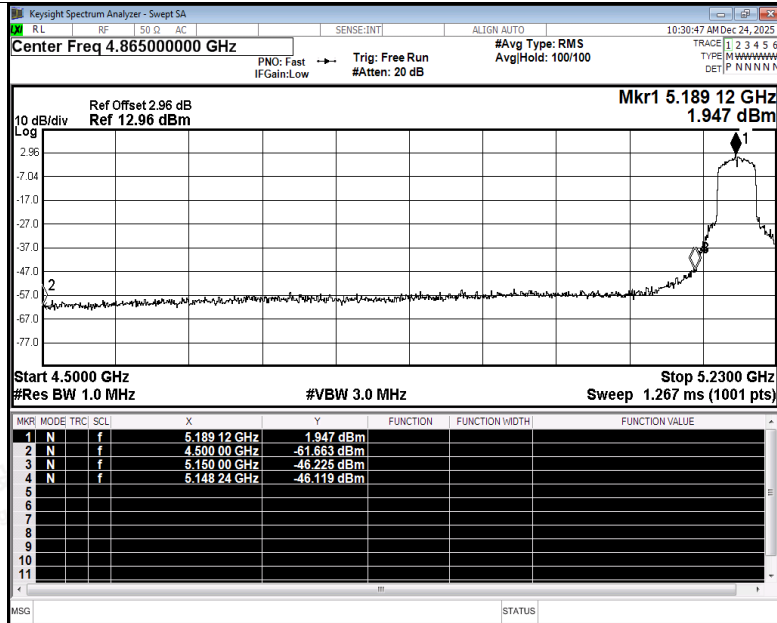

Restrict Band NVNT n40 5190MHz Ant4 Peak

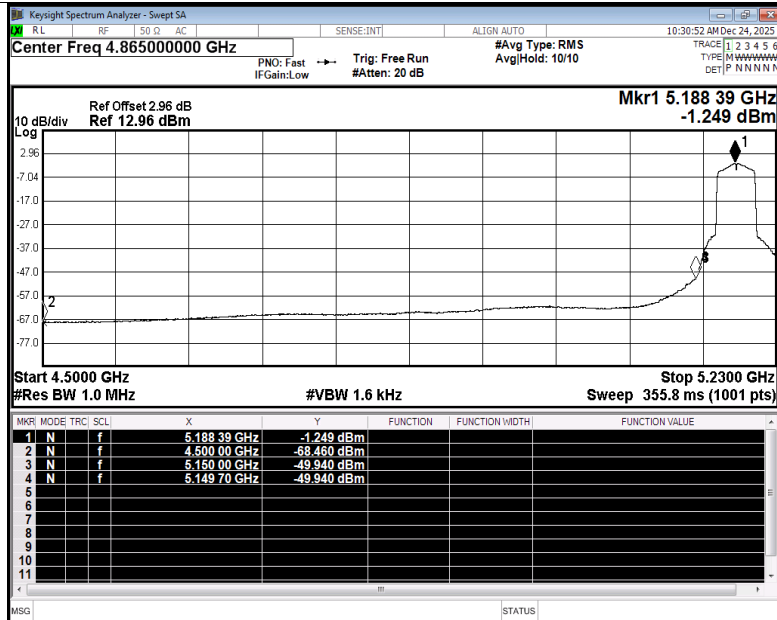

Restrict Band NVNT n40 5190MHz Ant4 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

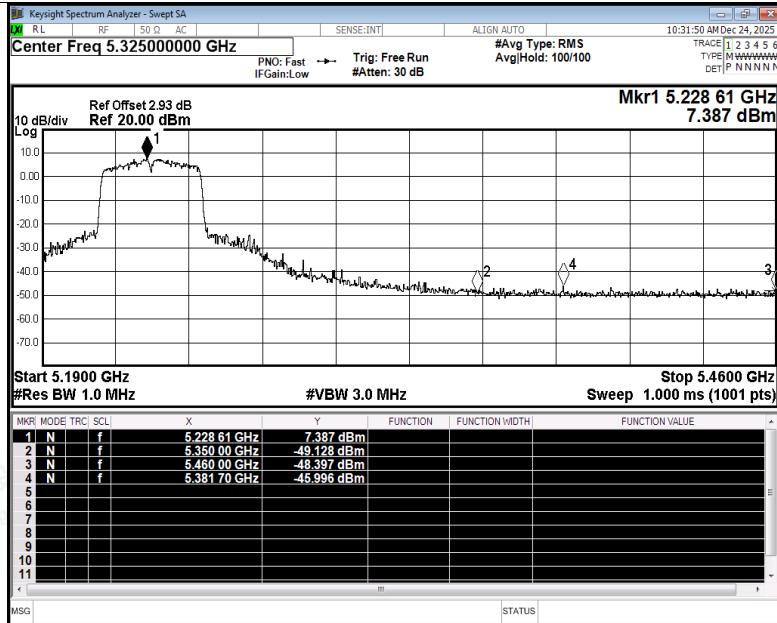

Restrict Band NVNT n40 5230MHz Ant4 Peak

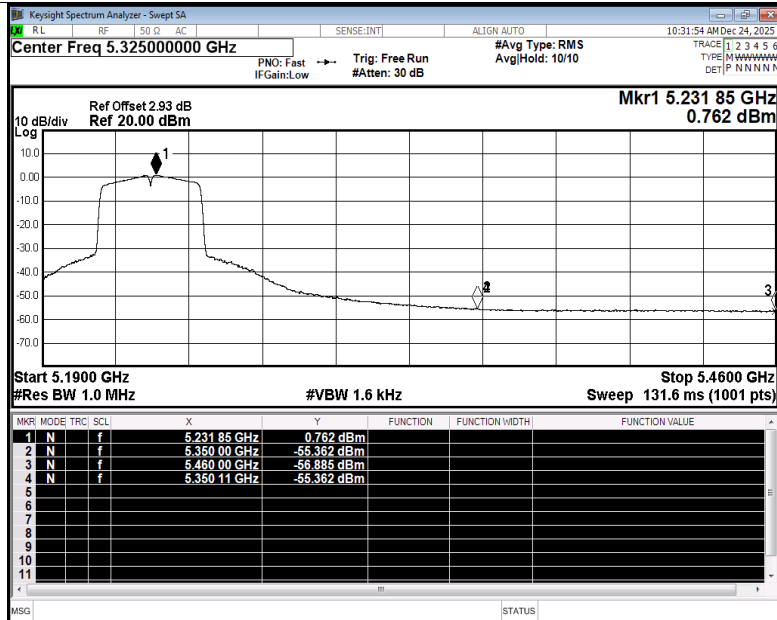

Restrict Band NVNT n40 5230MHz Ant4 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

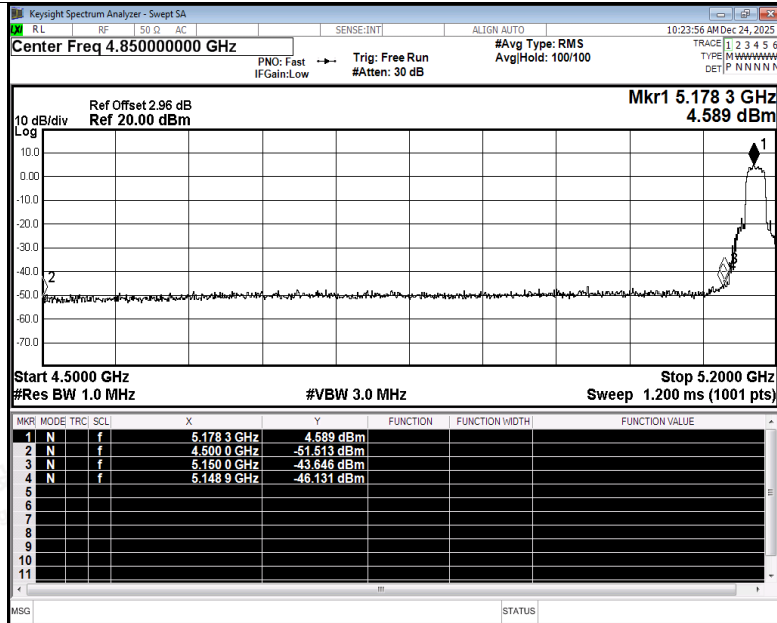

Restrict Band NVNT ac20 5180MHz Ant4 Peak

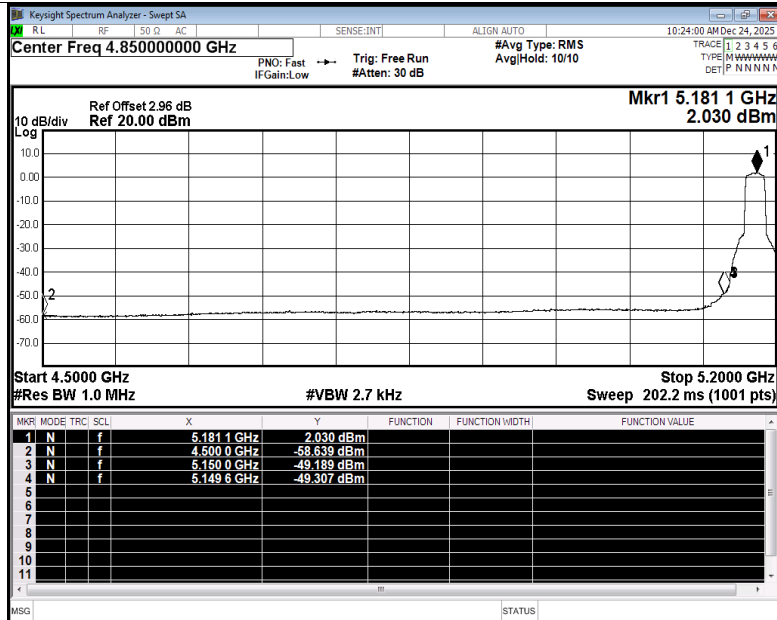

Restrict Band NVNT ac20 5180MHz Ant4 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

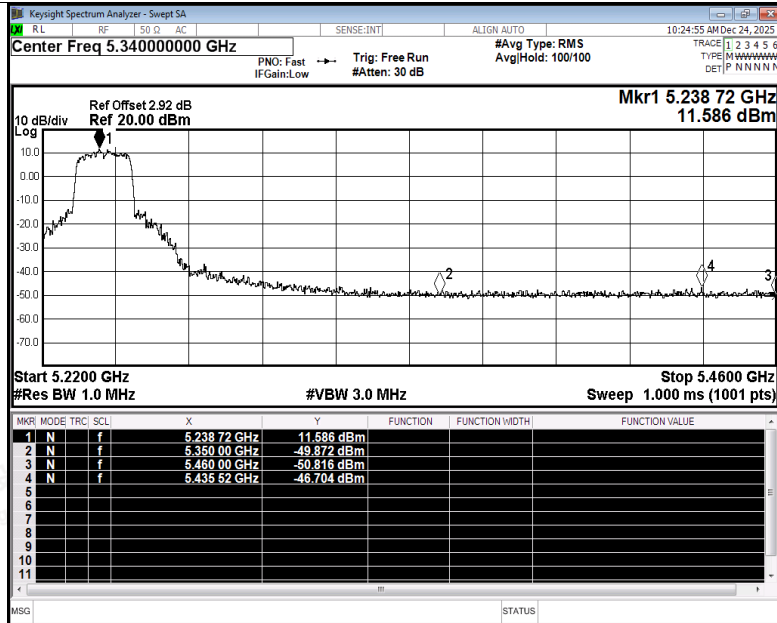

Restrict Band NVNT ac20 5240MHz Ant4 Peak

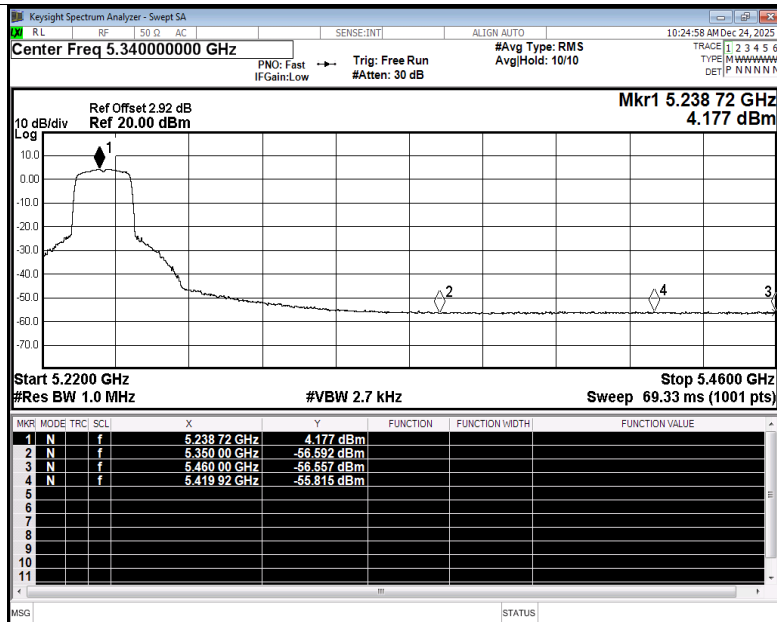

Restrict Band NVNT ac20 5240MHz Ant4 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

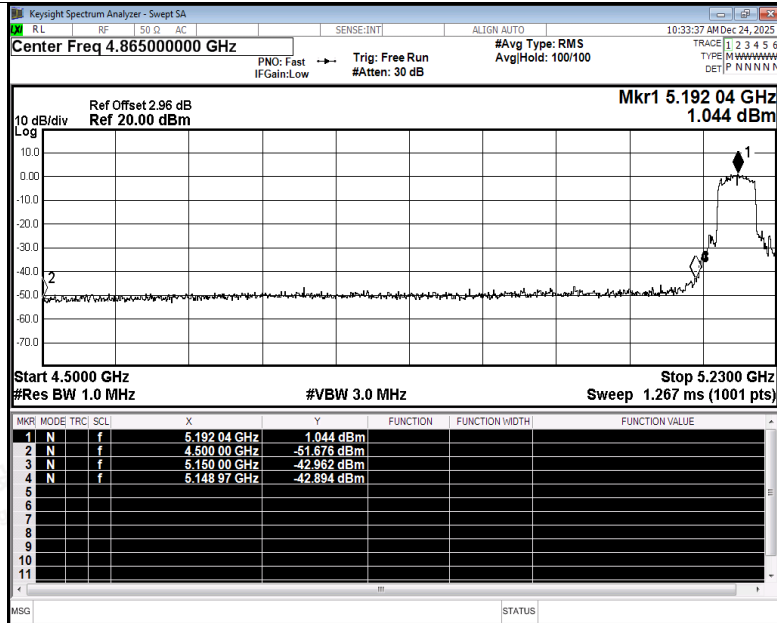

Restrict Band NVNT ac40 5190MHz Ant4 Peak

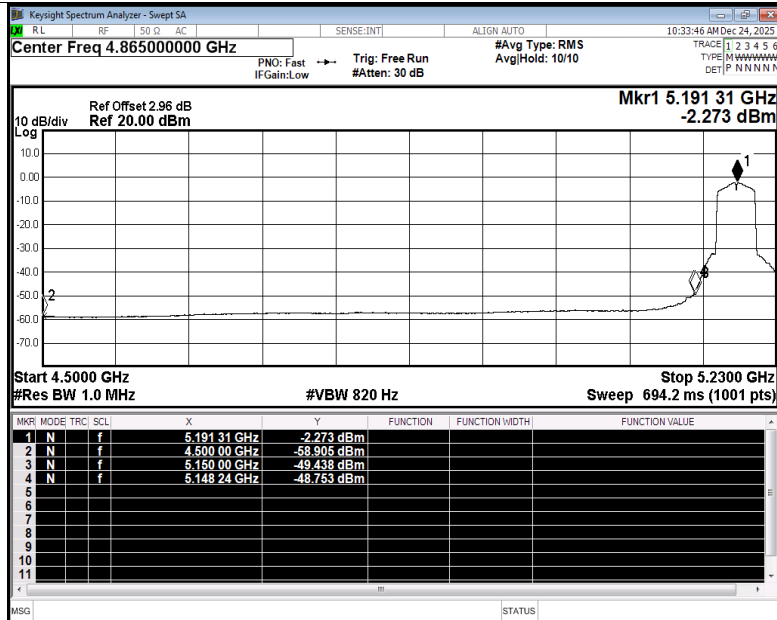

Restrict Band NVNT ac40 5190MHz Ant4 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

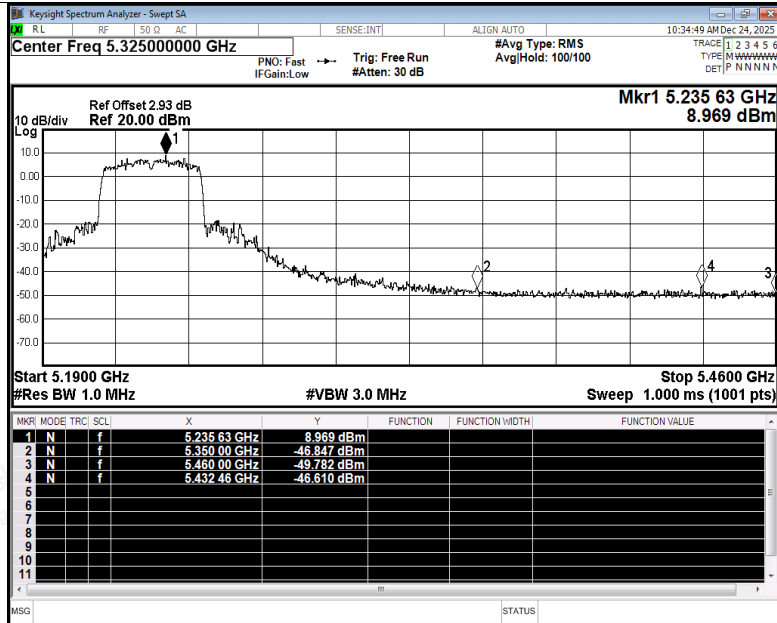

Restrict Band NVNT ac40 5230MHz Ant4 Peak

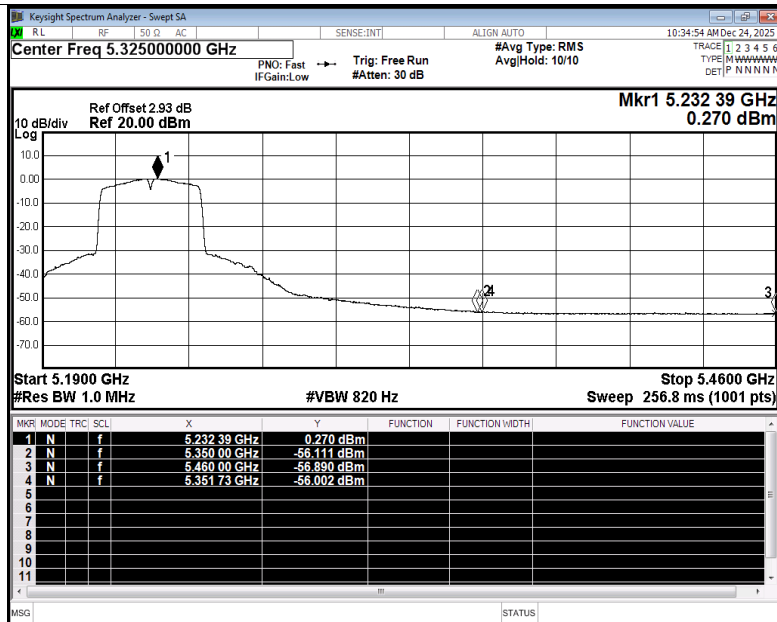

Restrict Band NVNT ac40 5230MHz Ant4 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

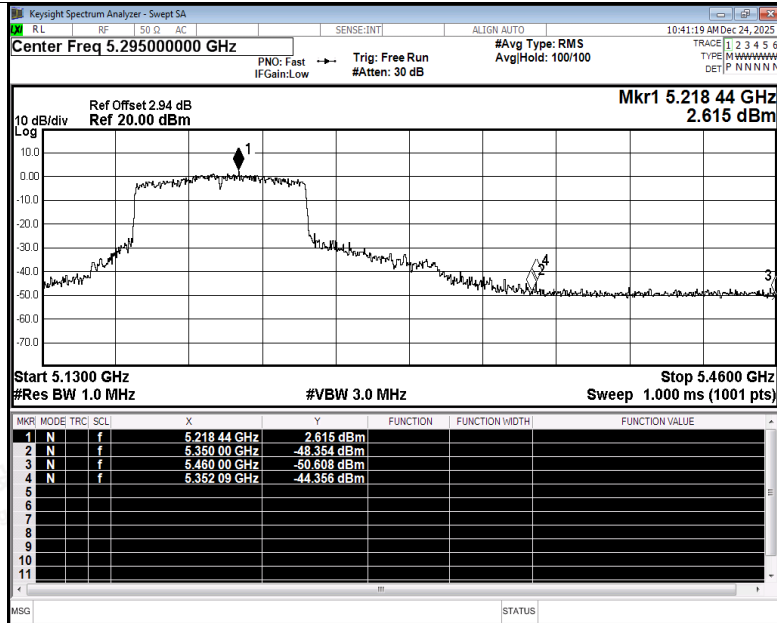

Restrict Band NVNT ac80 5210MHz Ant4 Peak

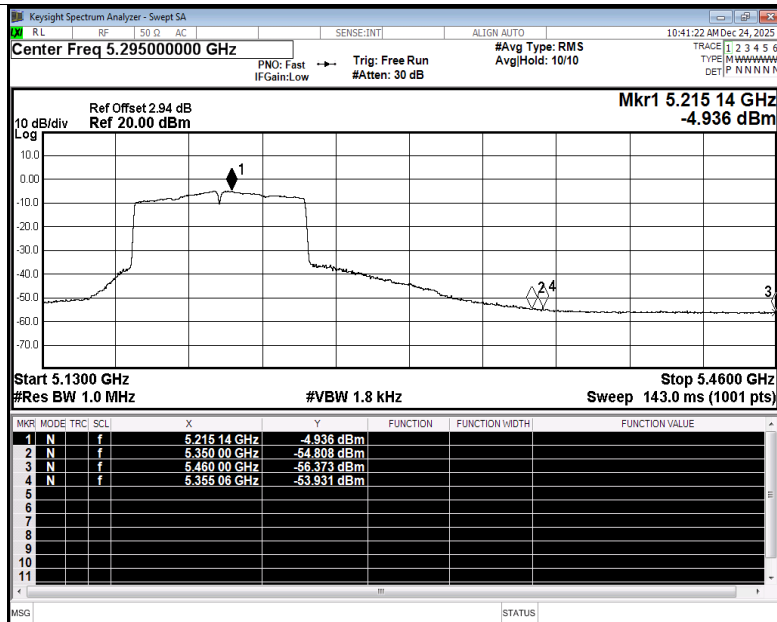

Restrict Band NVNT ac80 5210MHz Ant4 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

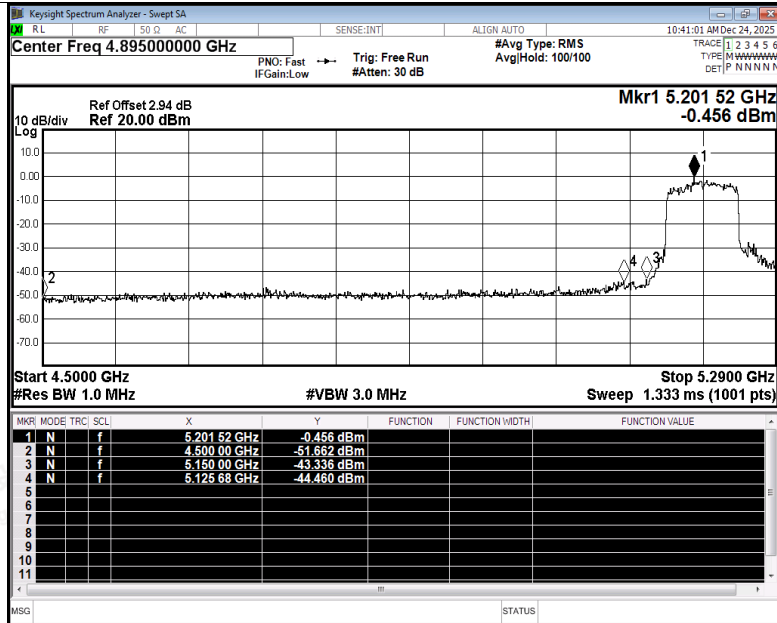

Restrict Band NVNT ac80 5210MHz Ant4 Peak

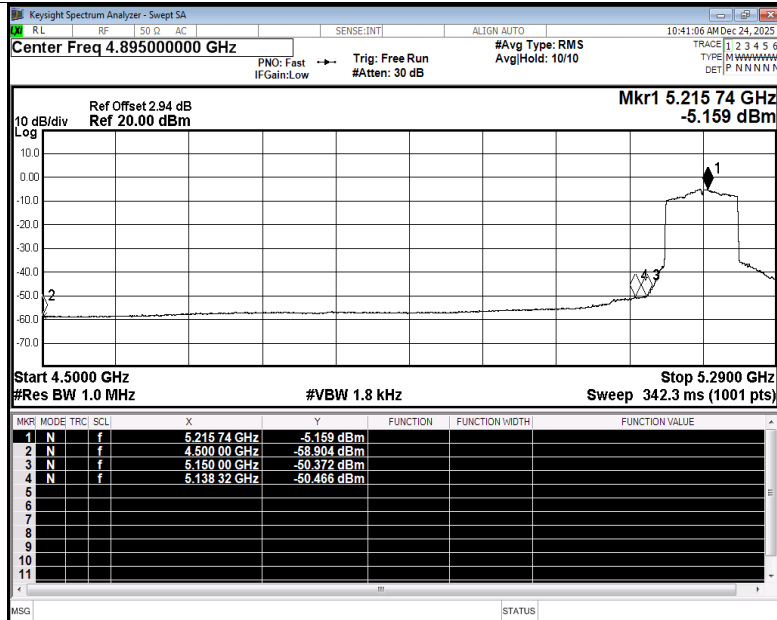

Restrict Band NVNT ac80 5210MHz Ant4 Average

