





Restrict Band NVNT ac40 5270MHz Ant1 Peak

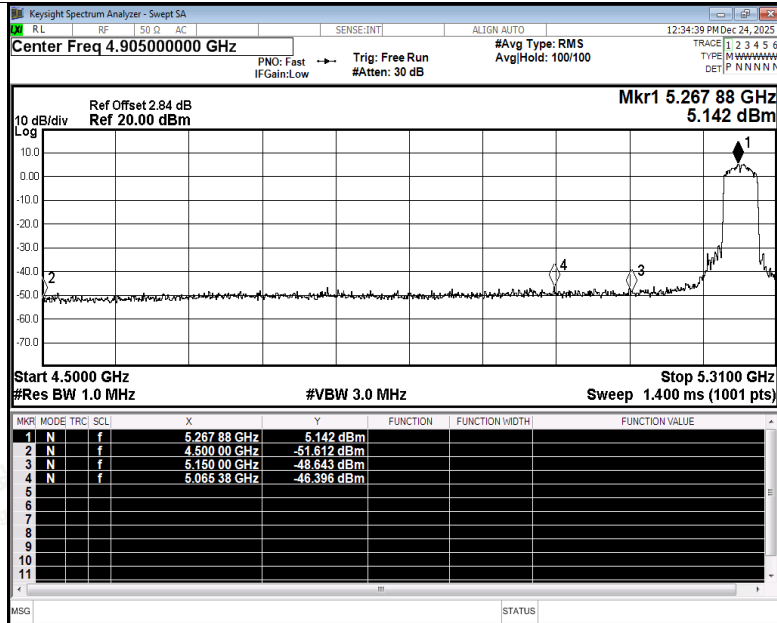

Restrict Band NVNT ac40 5270MHz Ant1 Average

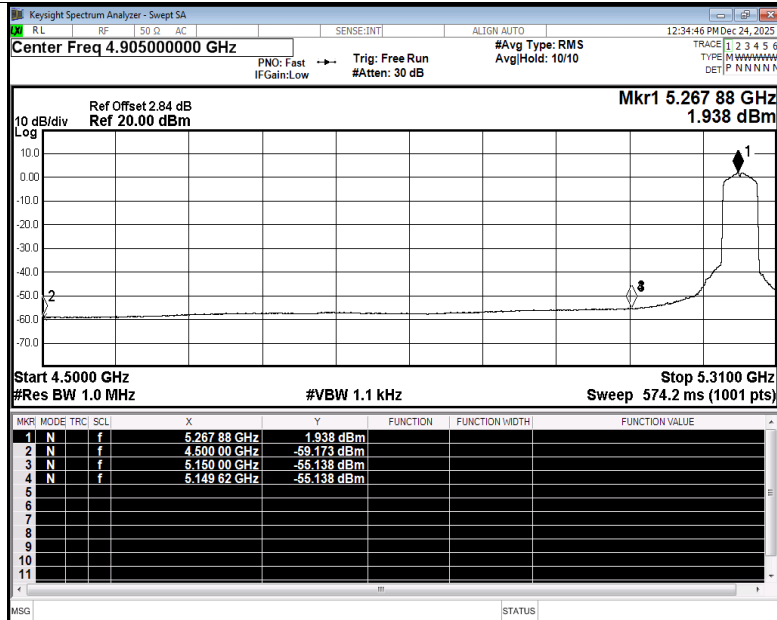


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

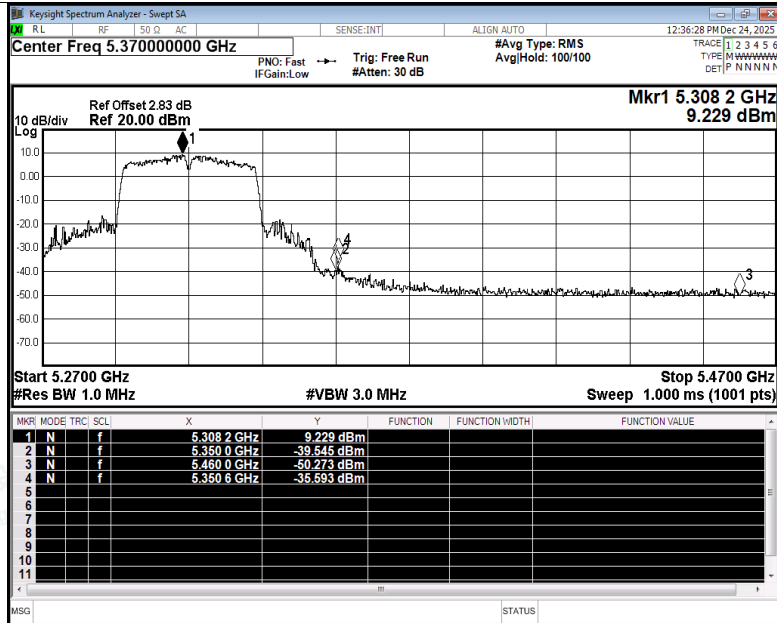

Restrict Band NVNT ac40 5310MHz Ant1 Peak

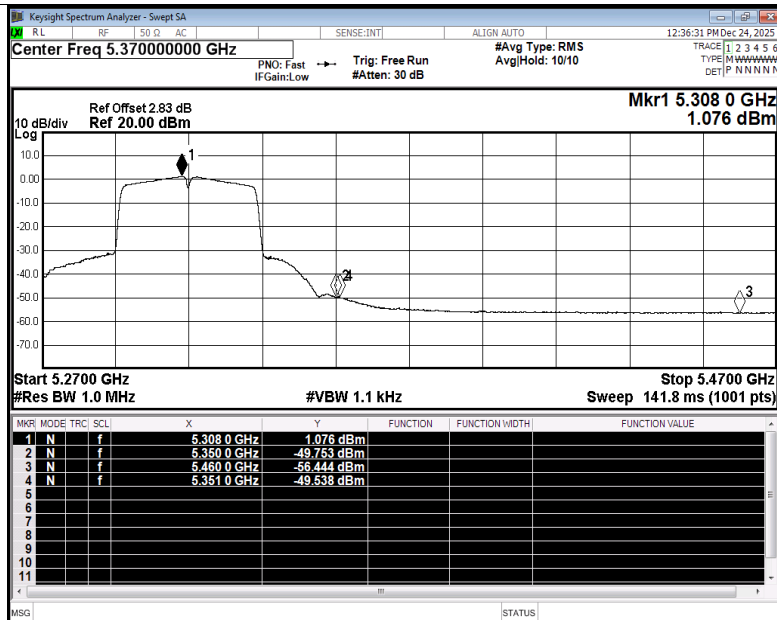

Restrict Band NVNT ac40 5310MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

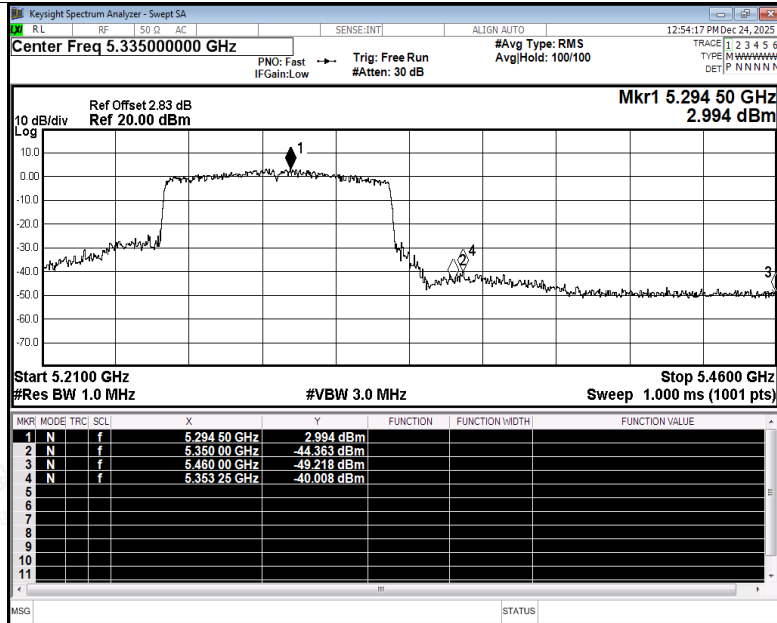

Restrict Band NVNT ac80 5290MHz Ant1 Peak

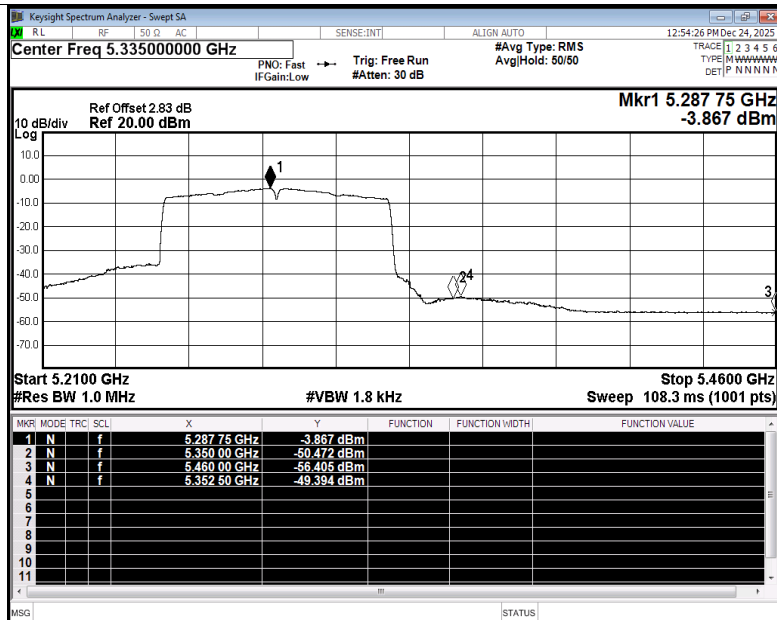

Restrict Band NVNT ac80 5290MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

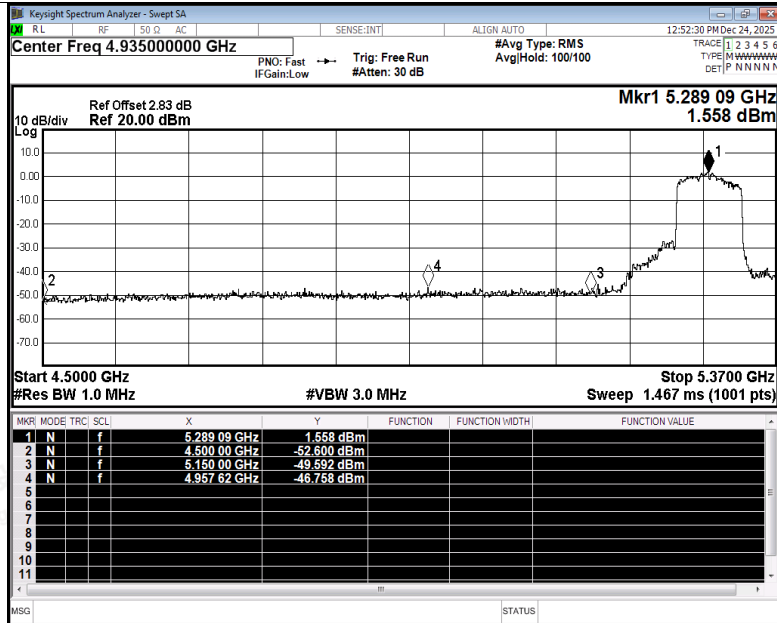

Restrict Band NVNT ac80 5290MHz Ant1 Peak

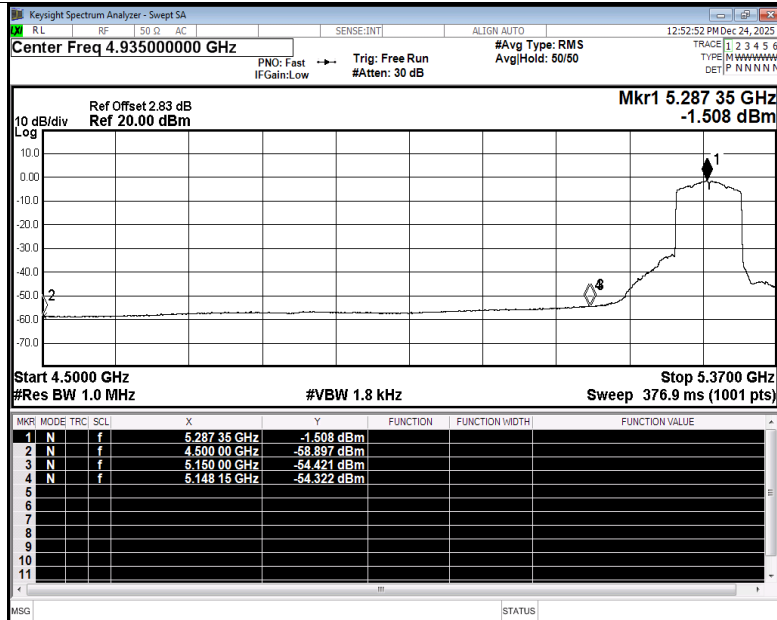

Restrict Band NVNT ac80 5290MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

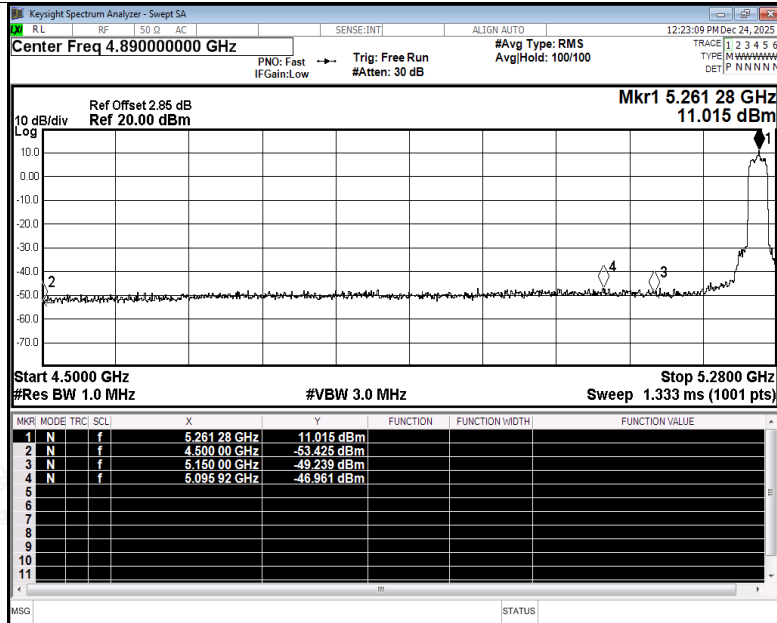

Restrict Band NVNT ax20 5260MHz Ant1 Peak

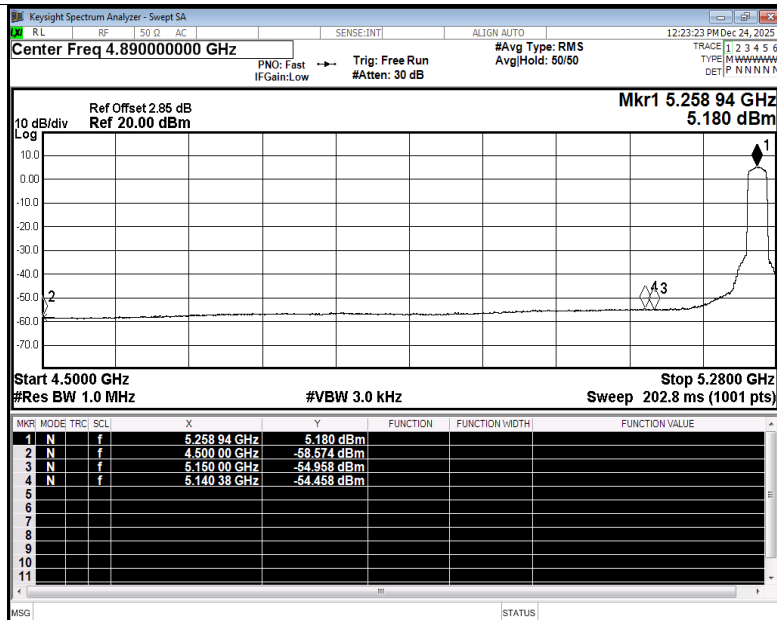

Restrict Band NVNT ax20 5260MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

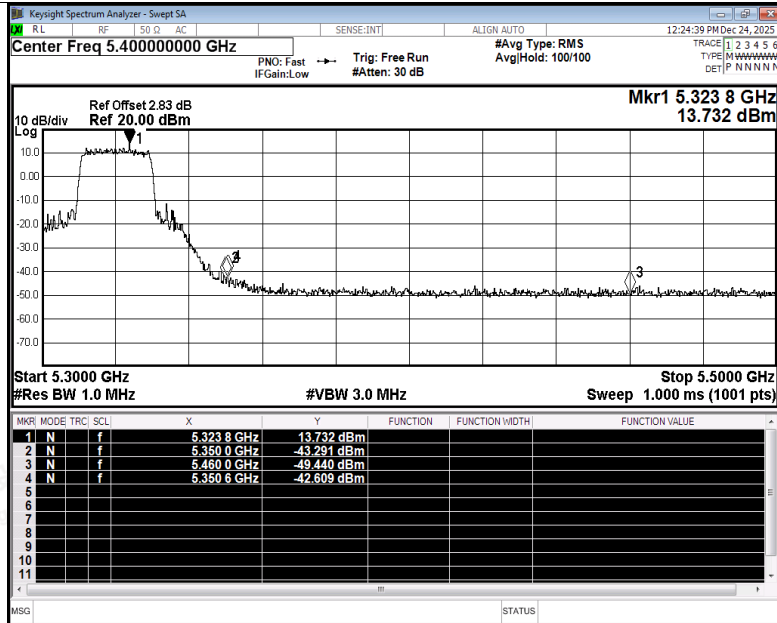

Restrict Band NVNT ax20 5320MHz Ant1 Peak

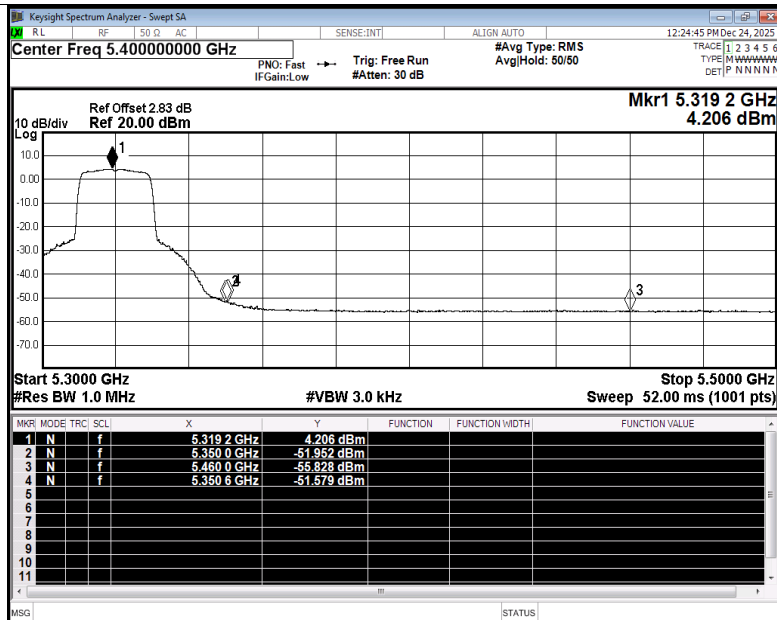

Restrict Band NVNT ax20 5320MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

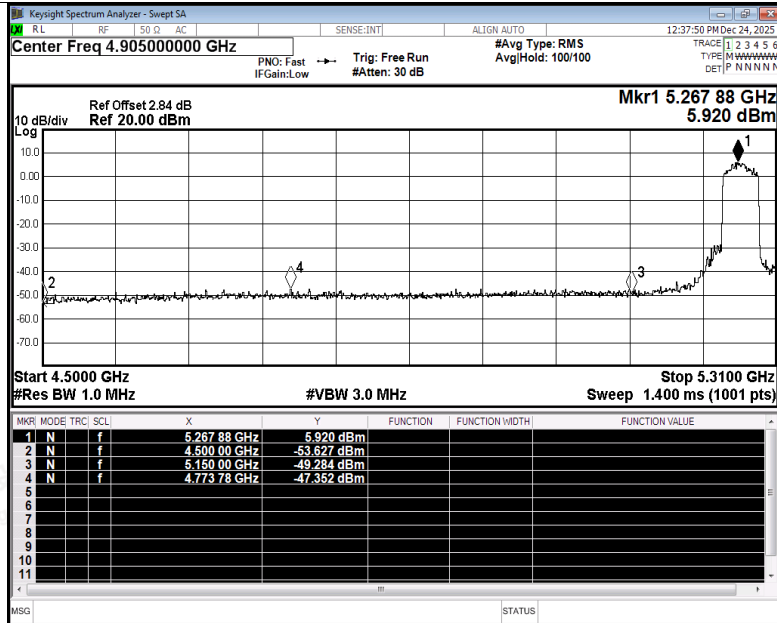

Restrict Band NVNT ax40 5270MHz Ant1 Peak

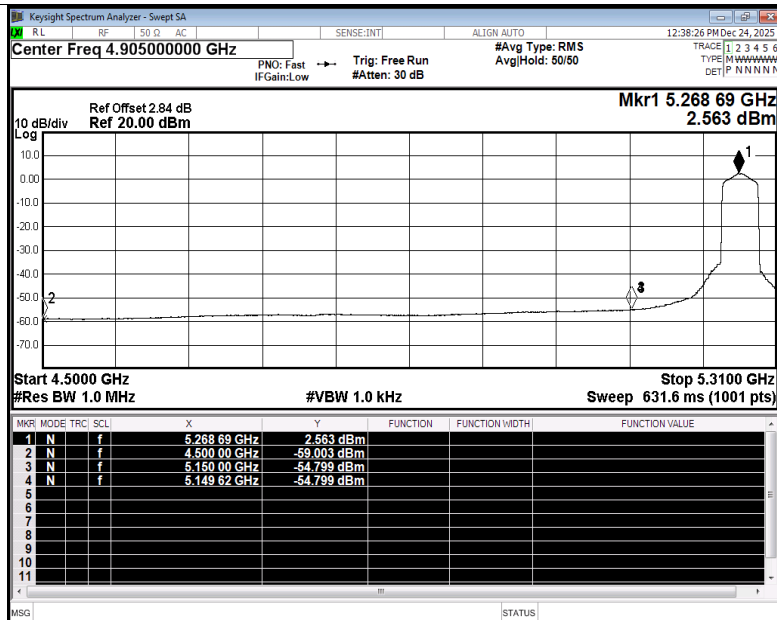

Restrict Band NVNT ax40 5270MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

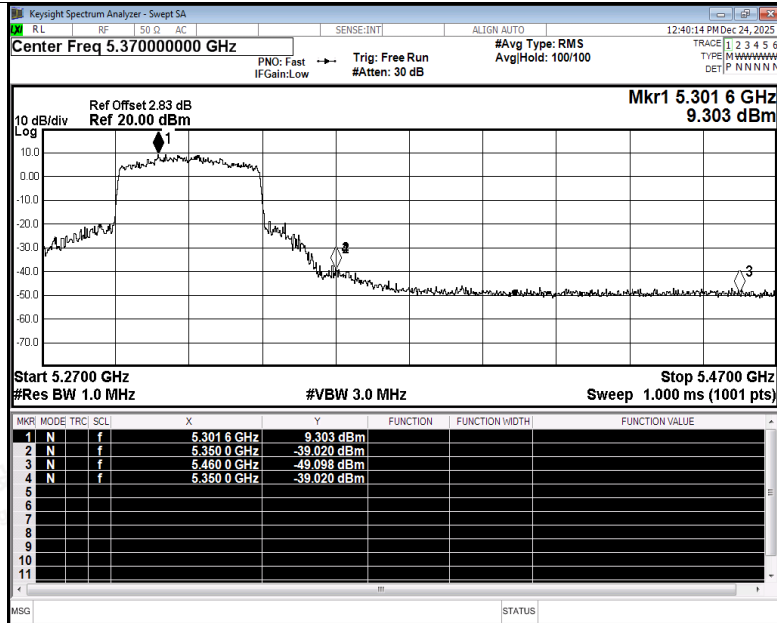


Restrict Band NVNT ax40 5310MHz Ant1 Peak

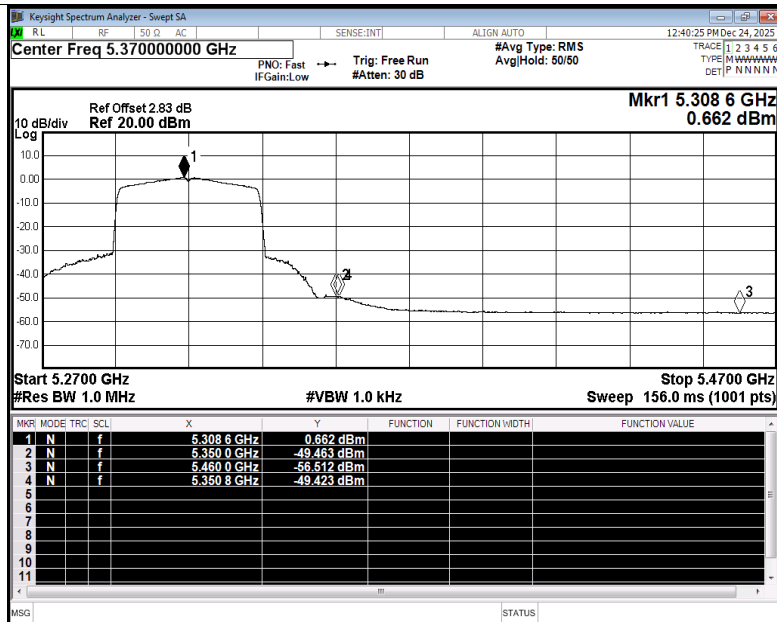


Restrict Band NVNT ax40 5310MHz Ant1 Average



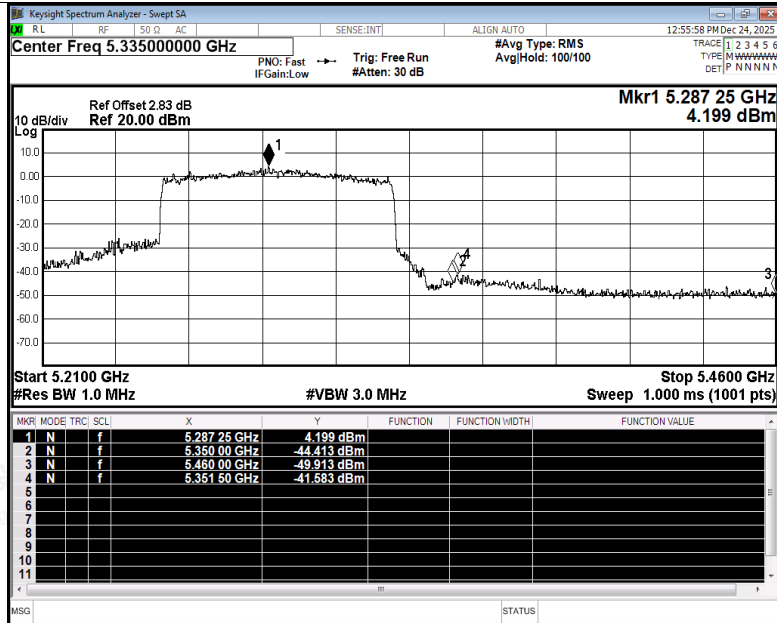

Restrict Band NVNT ax80 5290MHz Ant1 Peak

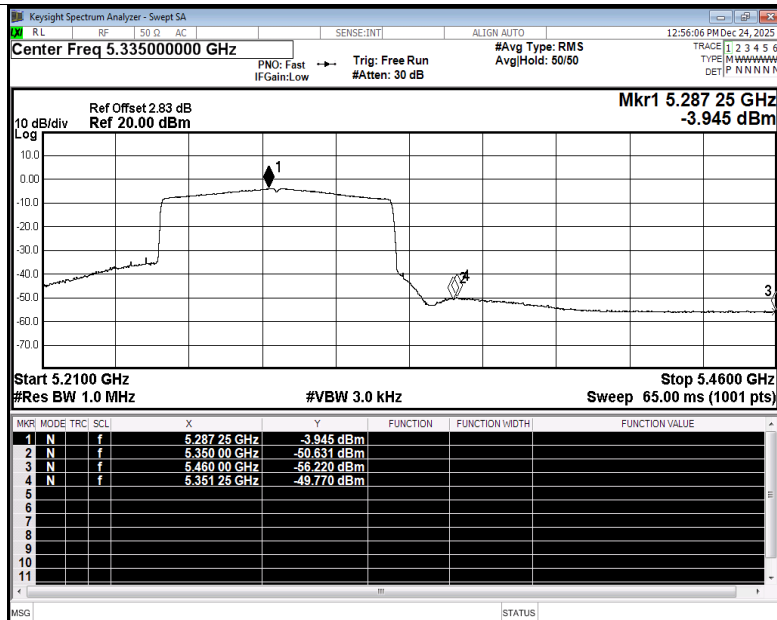

Restrict Band NVNT ax80 5290MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

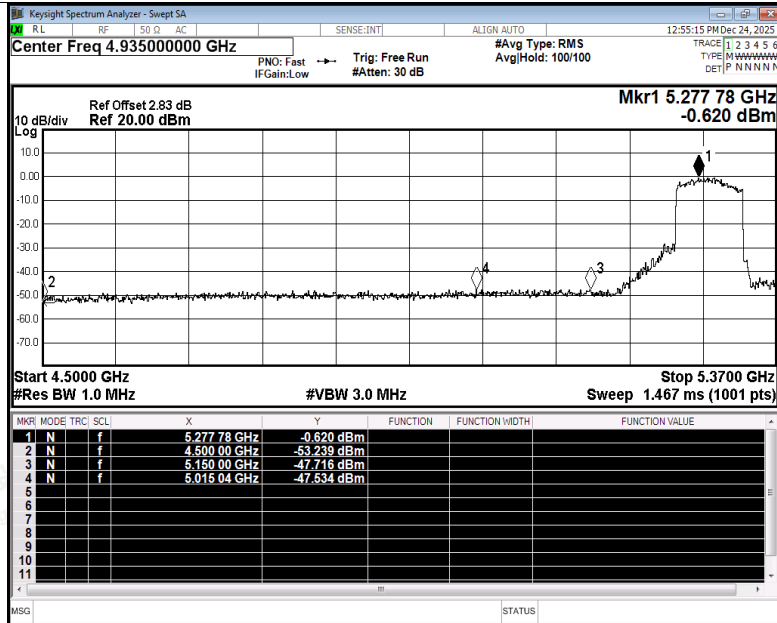

Restrict Band NVNT ax80 5290MHz Ant1 Peak

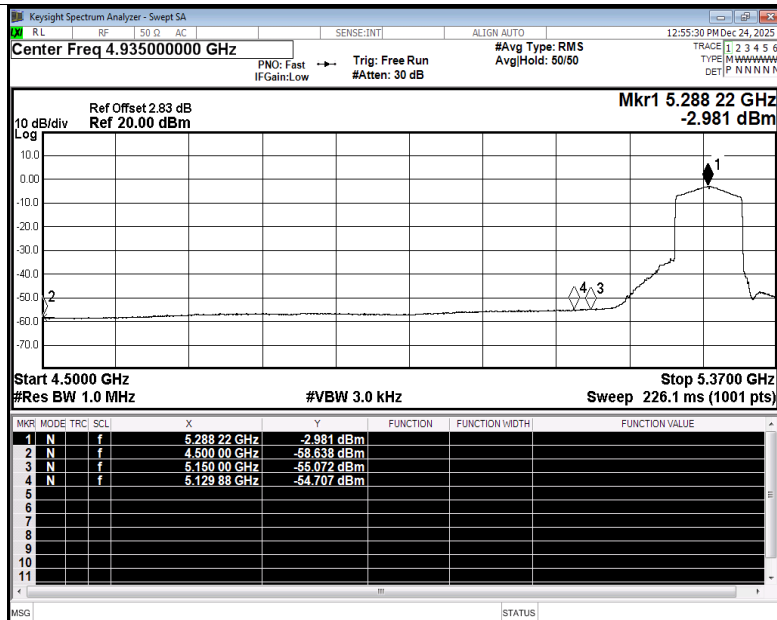

Restrict Band NVNT ax80 5290MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

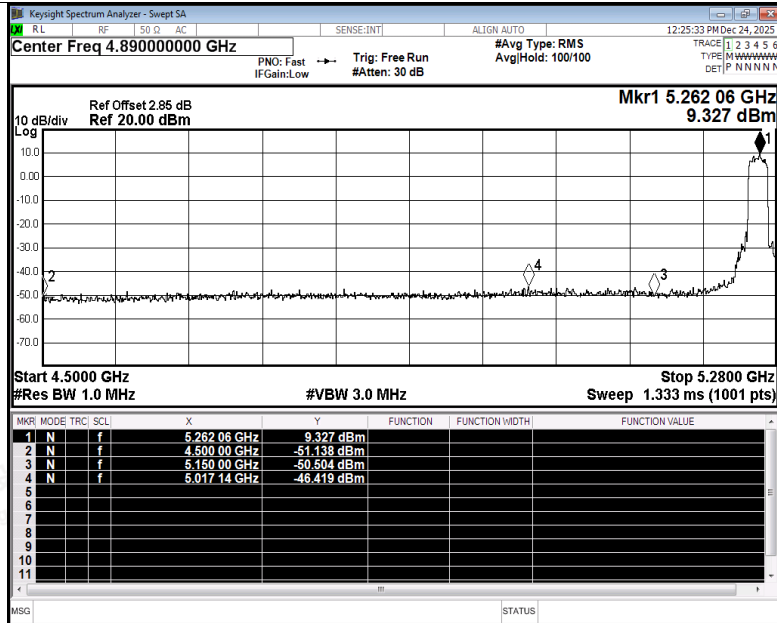

Restrict Band NVNT be20 5260MHz Ant1 Peak

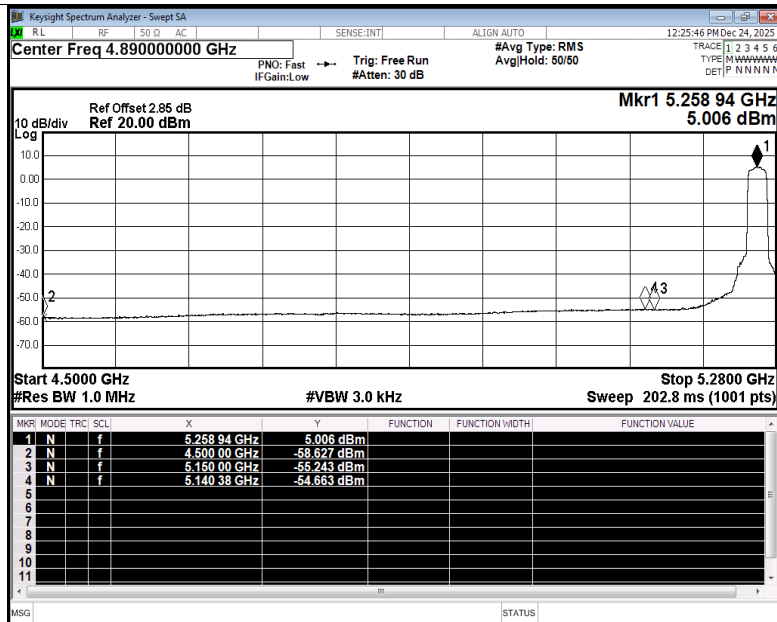

Restrict Band NVNT be20 5260MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

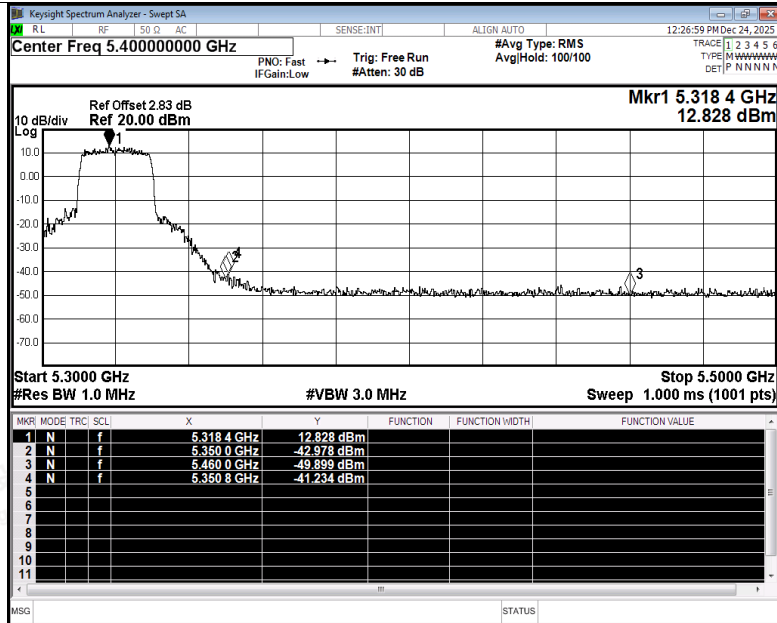

Restrict Band NVNT be20 5320MHz Ant1 Peak

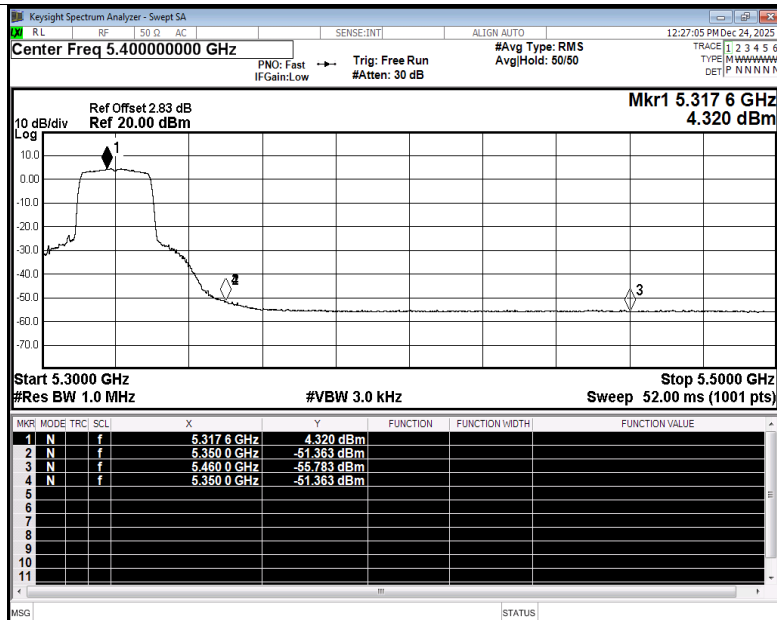

Restrict Band NVNT be20 5320MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

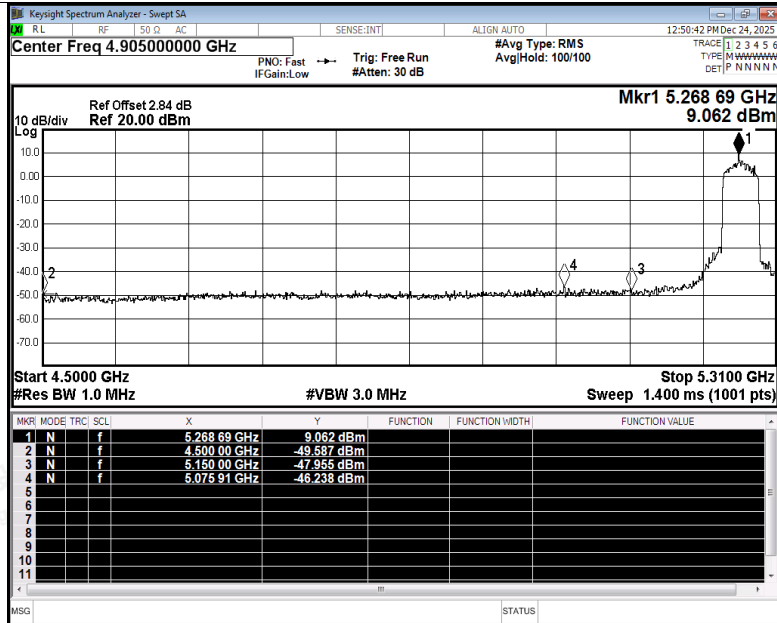

Restrict Band NVNT be40 5270MHz Ant1 Peak

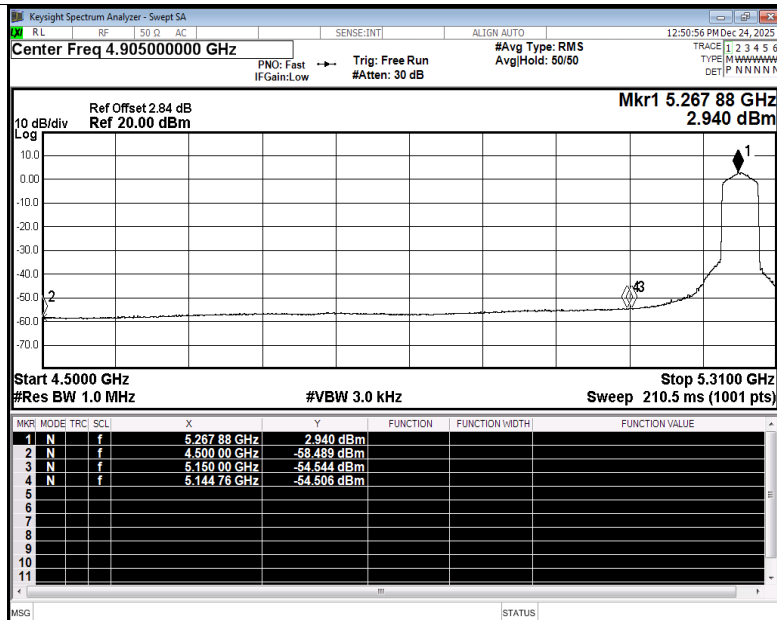

Restrict Band NVNT be40 5270MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

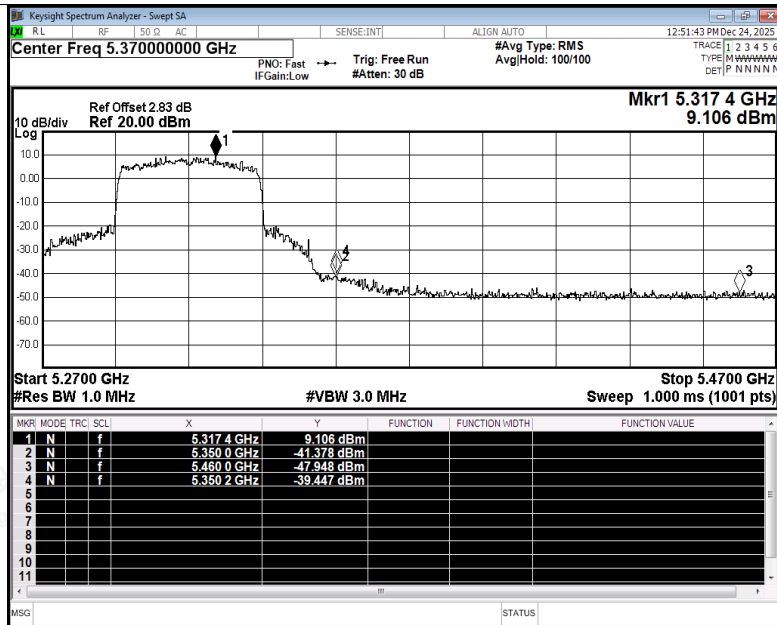

Restrict Band NVNT be40 5310MHz Ant1 Peak

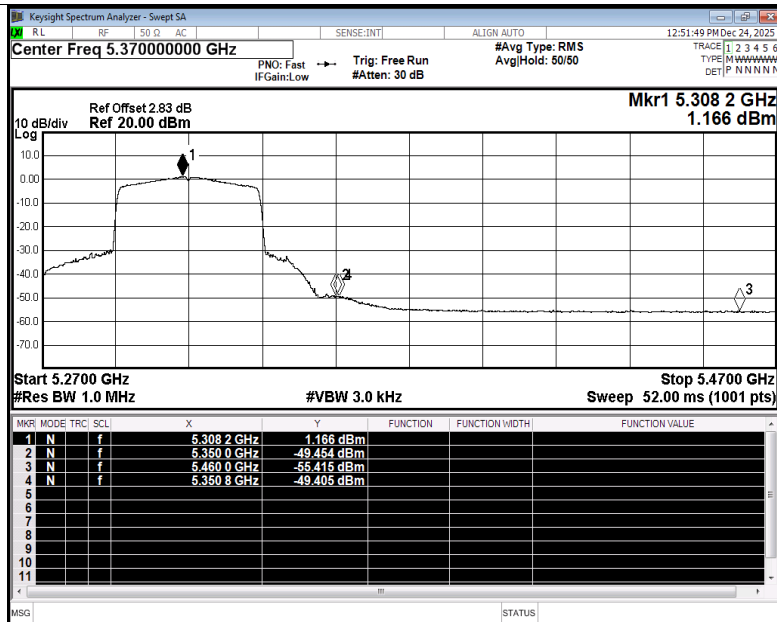

Restrict Band NVNT be40 5310MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

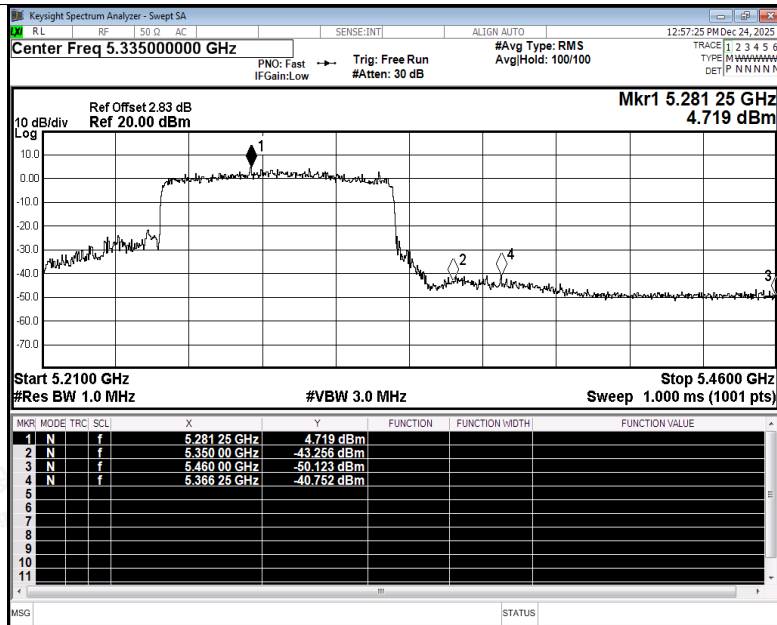

Restrict Band NVNT be80 5290MHz Ant1 Peak

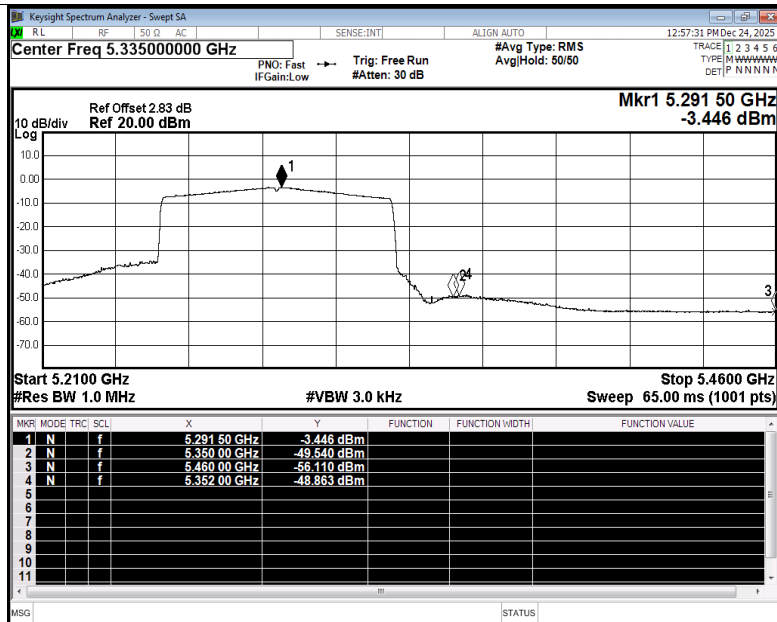

Restrict Band NVNT be80 5290MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

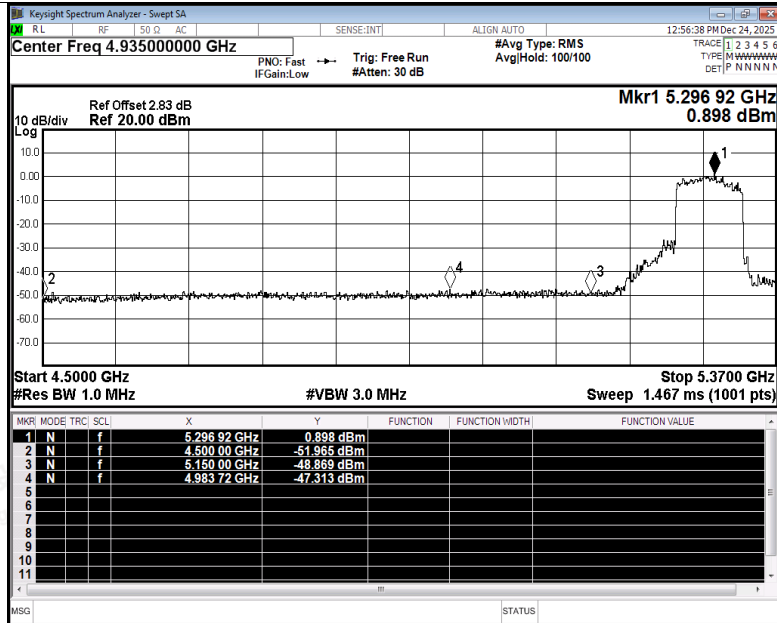

Restrict Band NVNT be80 5290MHz Ant1 Peak

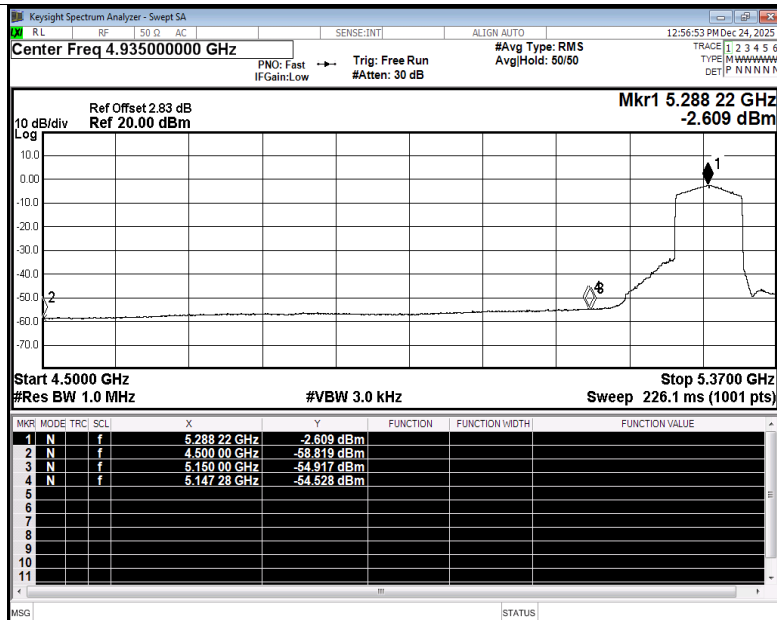

Restrict Band NVNT be80 5290MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant2	4500	-50.81	6.6	51.02	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-59.25	6.6	42.58	Average	54	Pass
NVNT	a	5260	Ant2	5057.7	-46.67	6.6	55.16	Peak	68.2	Pass
NVNT	a	5260	Ant2	5040.54	-55.78	6.6	46.05	Average	54	Pass
NVNT	a	5260	Ant2	5150	-50.99	6.6	50.84	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-56.35	6.6	45.48	Average	54	Pass
NVNT	a	5320	Ant2	5350	-44.32	6.6	57.51	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-53.06	6.6	48.77	Average	54	Pass
NVNT	a	5320	Ant2	5350	-44.32	6.6	57.51	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-53.06	6.6	48.77	Average	54	Pass
NVNT	a	5320	Ant2	5460	-50.16	6.6	51.67	Peak	68.2	Pass
NVNT	a	5320	Ant2	5460	-56.14	6.6	45.69	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-51.91	6.6	49.92	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-59.07	6.6	42.76	Average	54	Pass
NVNT	n20	5260	Ant2	5060.82	-47.02	6.6	54.81	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5051.46	-55.65	6.6	46.18	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-49.94	6.6	51.89	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-56.55	6.6	45.28	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-46.19	6.6	55.64	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-53.22	6.6	48.61	Average	54	Pass
NVNT	n20	5320	Ant2	5351.2	-41.69	6.6	60.14	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-53.22	6.6	48.61	Average	54	Pass
NVNT	n20	5320	Ant2	5460	-47.64	6.6	54.19	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5460	-56.12	6.6	45.71	Average	54	Pass
NVNT	n40	5270	Ant2	4500	-51.76	6.6	50.07	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4500	-59.11	6.6	42.72	Average	54	Pass
NVNT	n40	5270	Ant2	5075.91	-46.68	6.6	55.15	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5036.22	-55.55	6.6	46.28	Average	54	Pass
NVNT	n40	5270	Ant2	5150	-49.57	6.6	52.26	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5150	-56.22	6.6	45.61	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-43.61	6.6	58.22	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-49.79	6.6	52.04	Average	54	Pass
NVNT	n40	5310	Ant2	5354.4	-40	6.6	61.83	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350.8	-49.28	6.6	52.55	Average	54	Pass
NVNT	n40	5310	Ant2	5460	-48.93	6.6	52.9	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5460	-56.15	6.6	45.68	Average	54	Pass
NVNT	ac20	5260	Ant2	4500	-52.61	6.6	49.22	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4500	-58.91	6.6	42.92	Average	54	Pass
NVNT	ac20	5260	Ant2	5054.58	-46.9	6.6	54.93	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant2	5123.22	-54.82	6.6	47.01	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-49.34	6.6	52.49	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-55.86	6.6	45.97	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-42.04	6.6	59.79	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-52.08	6.6	49.75	Average	54	Pass
NVNT	ac20	5320	Ant2	5351.2	-42	6.6	59.83	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350.2	-52.02	6.6	49.81	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-46.96	6.6	54.87	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5460	-55.63	6.6	46.2	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-51.21	6.6	50.62	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4500	-58.98	6.6	42.85	Average	54	Pass
NVNT	ac40	5270	Ant2	5041.89	-45.56	6.6	56.27	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5052.42	-55.6	6.6	46.23	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-50.49	6.6	51.34	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5150	-55.95	6.6	45.88	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-40.14	6.6	61.69	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-50.32	6.6	51.51	Average	54	Pass
NVNT	ac40	5310	Ant2	5351.2	-37.43	6.6	64.4	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350.4	-50.25	6.6	51.58	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-49.86	6.6	51.97	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5460	-56.19	6.6	45.64	Average	54	Pass
NVNT	ac80	5290	Ant2	5350	-42.99	6.6	58.84	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350	-50.39	6.6	51.44	Average	54	Pass
NVNT	ac80	5290	Ant2	5361.75	-39.76	6.6	62.07	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5355.75	-49.3	6.6	52.53	Average	54	Pass
NVNT	ac80	5290	Ant2	5460	-50.27	6.6	51.56	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5460	-56.54	6.6	45.29	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-50.2	6.6	51.63	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-58.8	6.6	43.03	Average	54	Pass
NVNT	ac80	5290	Ant2	4676.61	-47.49	6.6	54.34	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5135.1	-55.62	6.6	46.21	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-51.21	6.6	50.62	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-55.98	6.6	45.85	Average	54	Pass
NVNT	ax20	5260	Ant2	4500	-51.15	6.6	50.68	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4500	-59.09	6.6	42.74	Average	54	Pass
NVNT	ax20	5260	Ant2	5033.52	-46.65	6.6	55.18	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5046	-55.76	6.6	46.07	Average	54	Pass
NVNT	ax20	5260	Ant2	5150	-49.98	6.6	51.85	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5150	-56.32	6.6	45.51	Average	54	Pass
NVNT	ax20	5320	Ant2	5350	-40.69	6.6	61.14	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-52.71	6.6	49.12	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant2	5351.2	-40.62	6.6	61.21	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350.4	-52.49	6.6	49.34	Average	54	Pass
NVNT	ax20	5320	Ant2	5460	-47.46	6.6	54.37	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5460	-56.22	6.6	45.61	Average	54	Pass
NVNT	ax40	5270	Ant2	4500	-51.92	6.6	49.91	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4500	-59.03	6.6	42.8	Average	54	Pass
NVNT	ax40	5270	Ant2	5024.07	-46.87	6.6	54.96	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5040.27	-55.53	6.6	46.3	Average	54	Pass
NVNT	ax40	5270	Ant2	5150	-50.08	6.6	51.75	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5150	-56.01	6.6	45.82	Average	54	Pass
NVNT	ax40	5310	Ant2	5350	-41.42	6.6	60.41	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-49.32	6.6	52.51	Average	54	Pass
NVNT	ax40	5310	Ant2	5351.8	-38.7	6.6	63.13	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-49.32	6.6	52.51	Average	54	Pass
NVNT	ax40	5310	Ant2	5460	-49.04	6.6	52.79	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5460	-56.36	6.6	45.47	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-44.48	6.6	57.35	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-49.84	6.6	51.99	Average	54	Pass
NVNT	ax80	5290	Ant2	5352.25	-41.1	6.6	60.73	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5353.75	-49.12	6.6	52.71	Average	54	Pass
NVNT	ax80	5290	Ant2	5460	-49.39	6.6	52.44	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5460	-56.36	6.6	45.47	Average	54	Pass
NVNT	ax80	5290	Ant2	4500	-52.63	6.6	49.2	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	4500	-58.51	6.6	43.32	Average	54	Pass
NVNT	ax80	5290	Ant2	5008.95	-46.96	6.6	54.87	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5068.98	-55.19	6.6	46.64	Average	54	Pass
NVNT	ax80	5290	Ant2	5150	-48.76	6.6	53.07	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5150	-55.87	6.6	45.96	Average	54	Pass
NVNT	be20	5260	Ant2	4500	-51.65	6.6	50.18	Peak	68.2	Pass
NVNT	be20	5260	Ant2	4500	-58.78	6.6	43.05	Average	54	Pass
NVNT	be20	5260	Ant2	5056.14	-46.38	6.6	55.45	Peak	68.2	Pass
NVNT	be20	5260	Ant2	5018.7	-54.82	6.6	47.01	Average	54	Pass
NVNT	be20	5260	Ant2	5150	-49.21	6.6	52.62	Peak	68.2	Pass
NVNT	be20	5260	Ant2	5150	-55.62	6.6	46.21	Average	54	Pass
NVNT	be20	5320	Ant2	5350	-40.05	6.6	61.78	Peak	68.2	Pass
NVNT	be20	5320	Ant2	5350	-51.18	6.6	50.65	Average	54	Pass
NVNT	be20	5320	Ant2	5350	-40.05	6.6	61.78	Peak	68.2	Pass
NVNT	be20	5320	Ant2	5350	-51.18	6.6	50.65	Average	54	Pass
NVNT	be20	5320	Ant2	5460	-49.13	6.6	52.7	Peak	68.2	Pass
NVNT	be20	5320	Ant2	5460	-55.7	6.6	46.13	Average	54	Pass
NVNT	be40	5270	Ant2	4500	-51.56	6.6	50.27	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5270	Ant2	4500	-59	6.6	42.83	Average	54	Pass
NVNT	be40	5270	Ant2	5023.26	-47.07	6.6	54.76	Peak	68.2	Pass
NVNT	be40	5270	Ant2	5080.77	-55.53	6.6	46.3	Average	54	Pass
NVNT	be40	5270	Ant2	5150	-49.46	6.6	52.37	Peak	68.2	Pass
NVNT	be40	5270	Ant2	5150	-56.1	6.6	45.73	Average	54	Pass
NVNT	be40	5310	Ant2	5350	-43.51	6.6	58.32	Peak	68.2	Pass
NVNT	be40	5310	Ant2	5350	-50.22	6.6	51.61	Average	54	Pass
NVNT	be40	5310	Ant2	5350.2	-38.31	6.6	63.52	Peak	68.2	Pass
NVNT	be40	5310	Ant2	5350.6	-49.87	6.6	51.96	Average	54	Pass
NVNT	be40	5310	Ant2	5460	-47.94	6.6	53.89	Peak	68.2	Pass
NVNT	be40	5310	Ant2	5460	-56.39	6.6	45.44	Average	54	Pass
NVNT	be80	5290	Ant2	5350	-42.02	6.6	59.81	Peak	68.2	Pass
NVNT	be80	5290	Ant2	5350	-50.8	6.6	51.03	Average	54	Pass
NVNT	be80	5290	Ant2	5368.25	-41.75	6.6	60.08	Peak	68.2	Pass
NVNT	be80	5290	Ant2	5353.25	-49.74	6.6	52.09	Average	54	Pass
NVNT	be80	5290	Ant2	5460	-51.27	6.6	50.56	Peak	68.2	Pass
NVNT	be80	5290	Ant2	5460	-56.52	6.6	45.31	Average	54	Pass
NVNT	be80	5290	Ant2	4500	-51.13	6.6	50.7	Peak	68.2	Pass
NVNT	be80	5290	Ant2	4500	-58.9	6.6	42.93	Average	54	Pass
NVNT	be80	5290	Ant2	4871.49	-47.2	6.6	54.63	Peak	68.2	Pass
NVNT	be80	5290	Ant2	5039.4	-55.52	6.6	46.31	Average	54	Pass
NVNT	be80	5290	Ant2	5150	-49.08	6.6	52.75	Peak	68.2	Pass
NVNT	be80	5290	Ant2	5150	-56.14	6.6	45.69	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

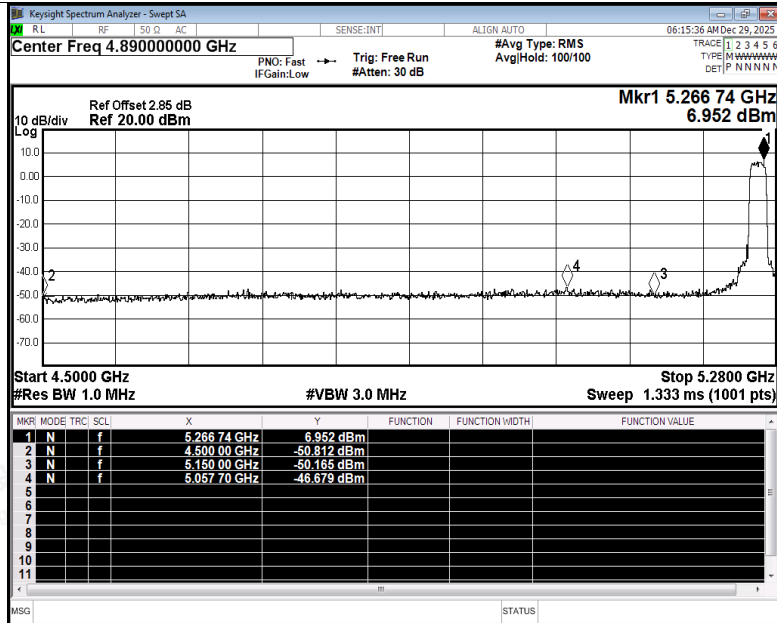

Restrict Band NVNT a 5260MHz Ant2 Peak

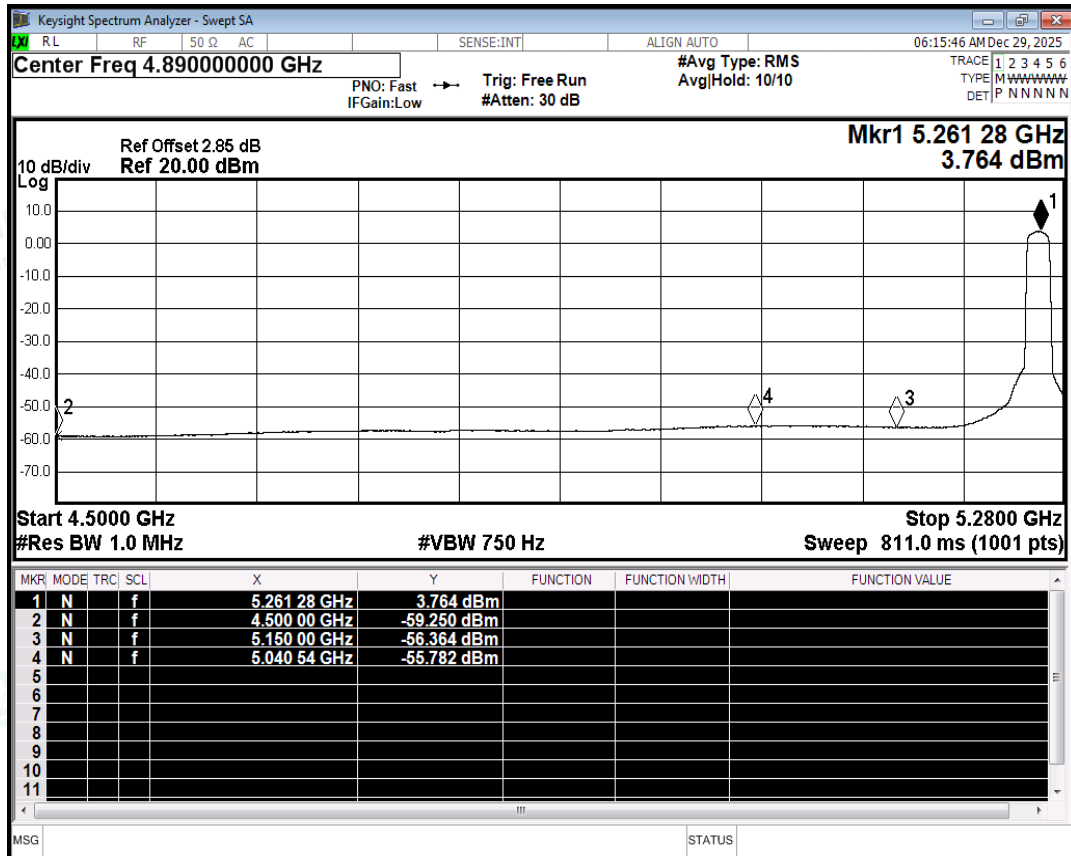

Restrict Band NVNT a 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

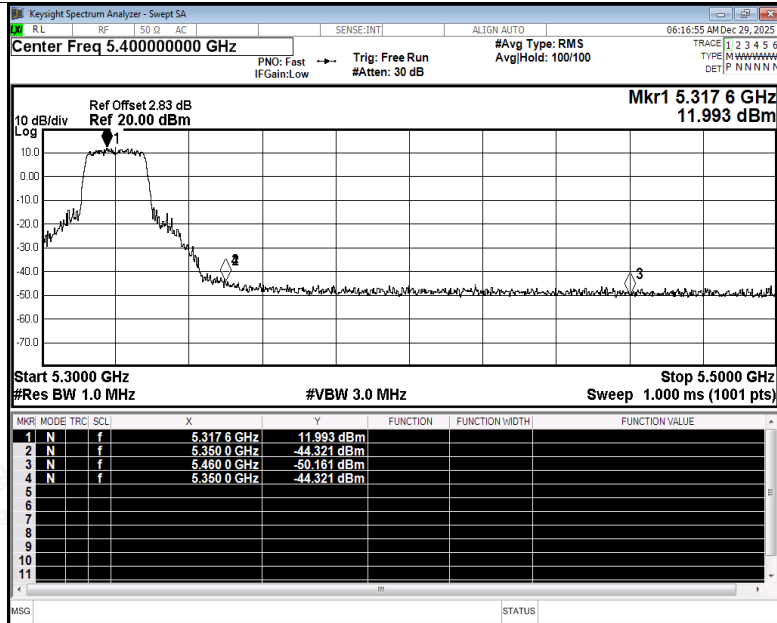

Restrict Band NVNT a 5320MHz Ant2 Peak

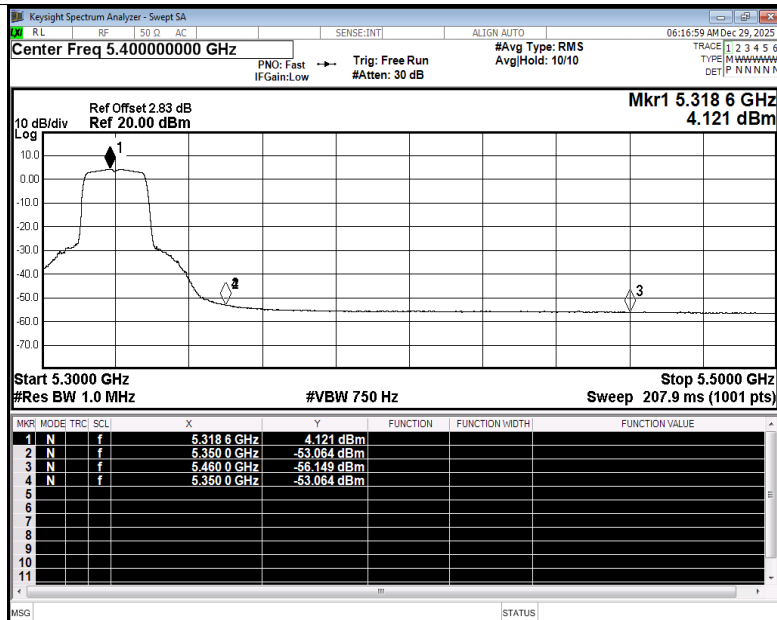

Restrict Band NVNT a 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

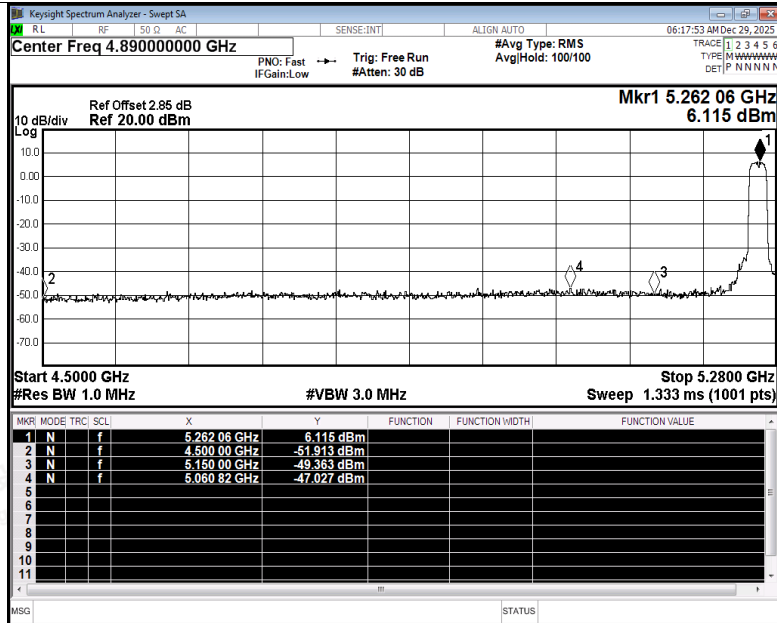

Restrict Band NVNT n20 5260MHz Ant2 Peak

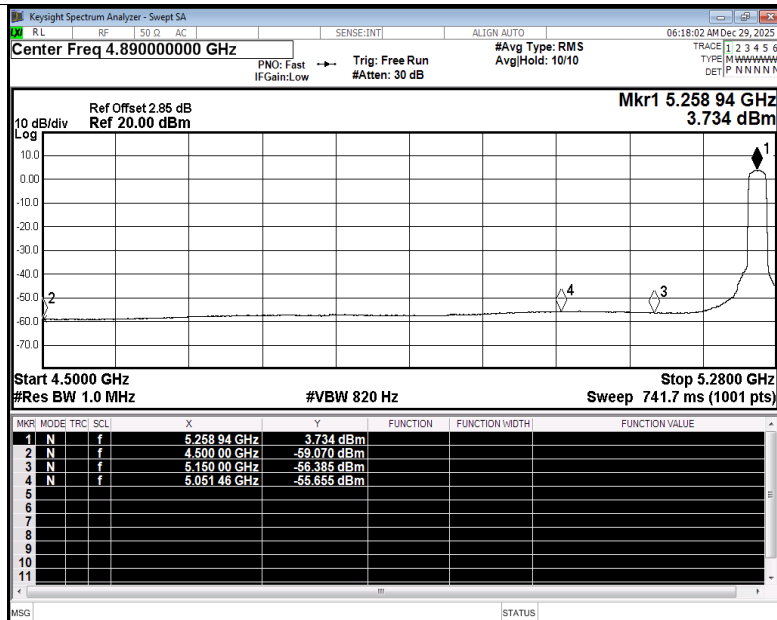

Restrict Band NVNT n20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

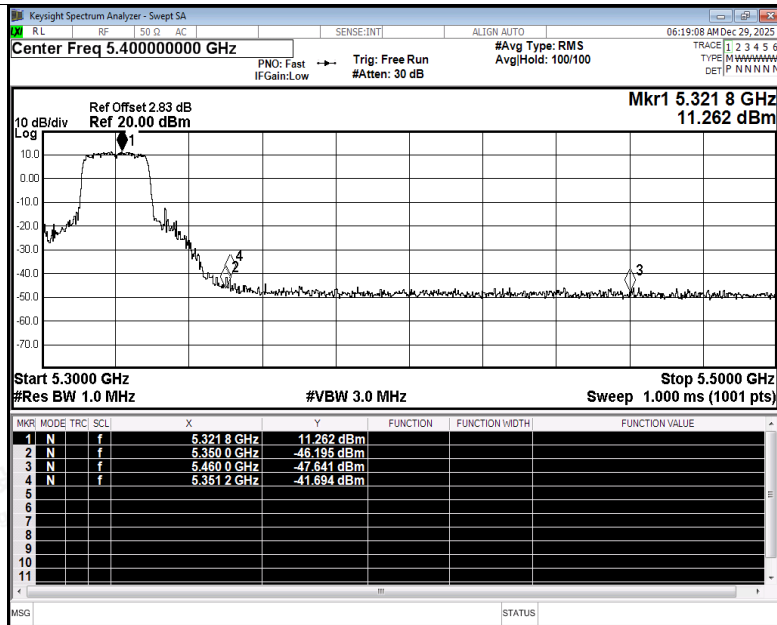

Restrict Band NVNT n20 5320MHz Ant2 Peak

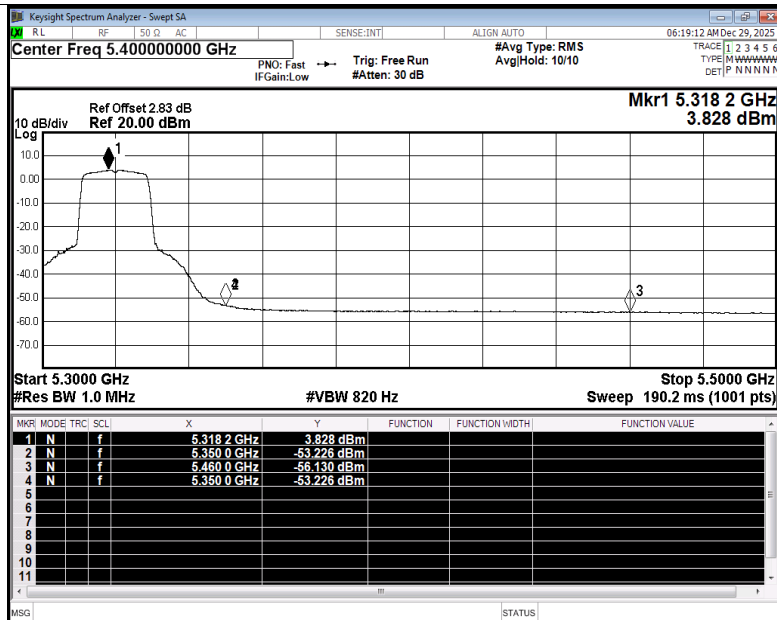

Restrict Band NVNT n20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

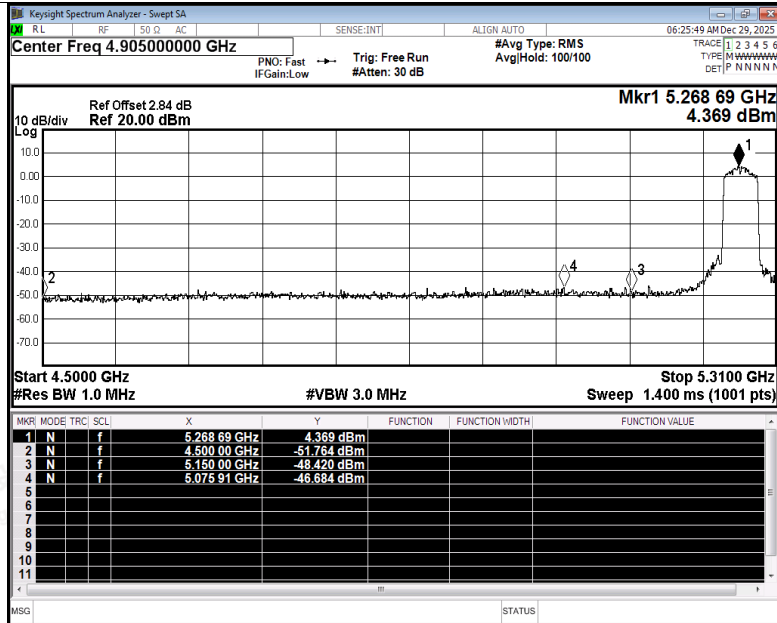

Restrict Band NVNT n40 5270MHz Ant2 Peak

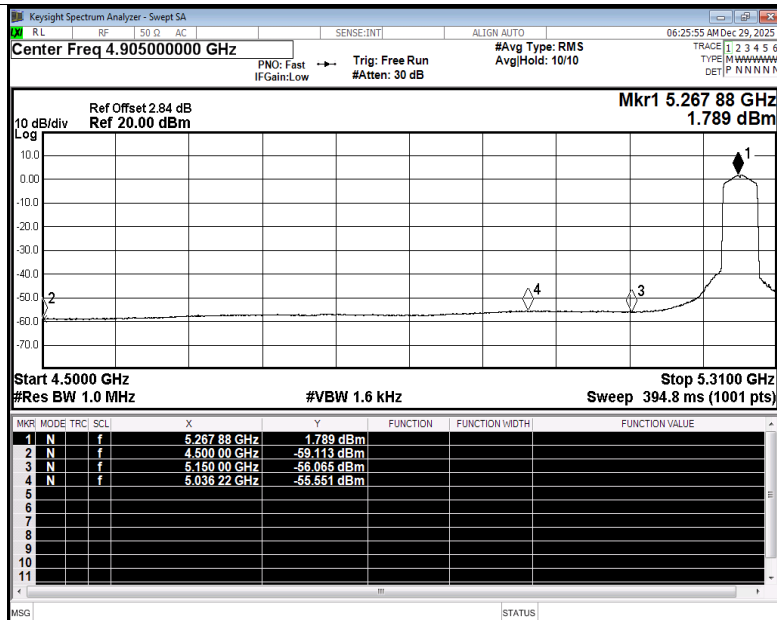

Restrict Band NVNT n40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

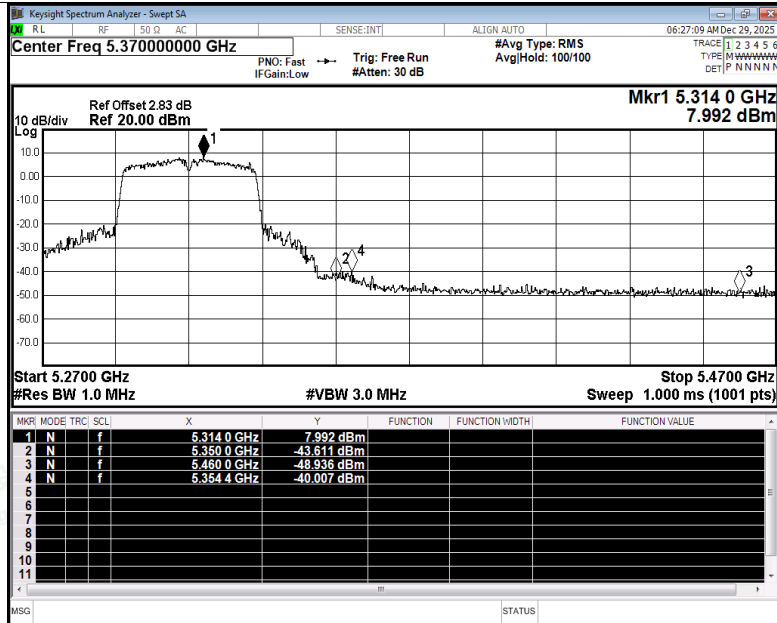

Restrict Band NVNT n40 5310MHz Ant2 Peak

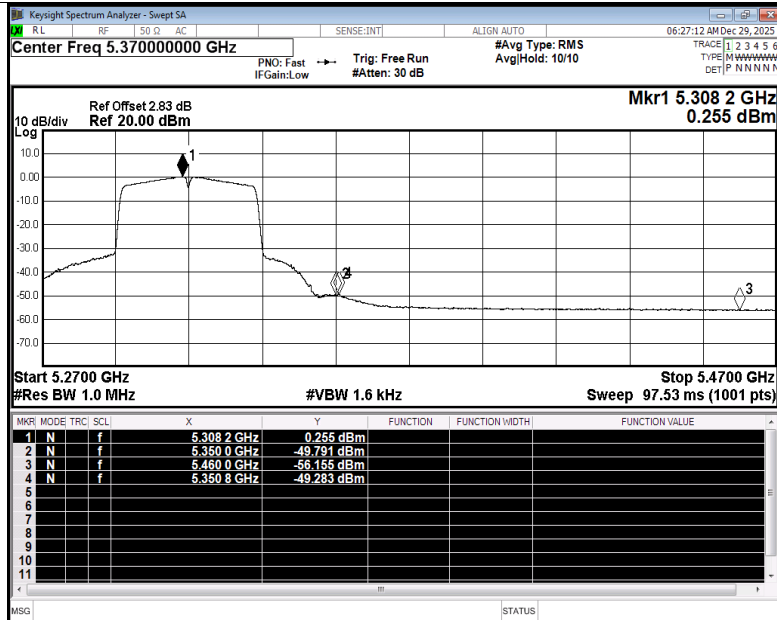

Restrict Band NVNT n40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

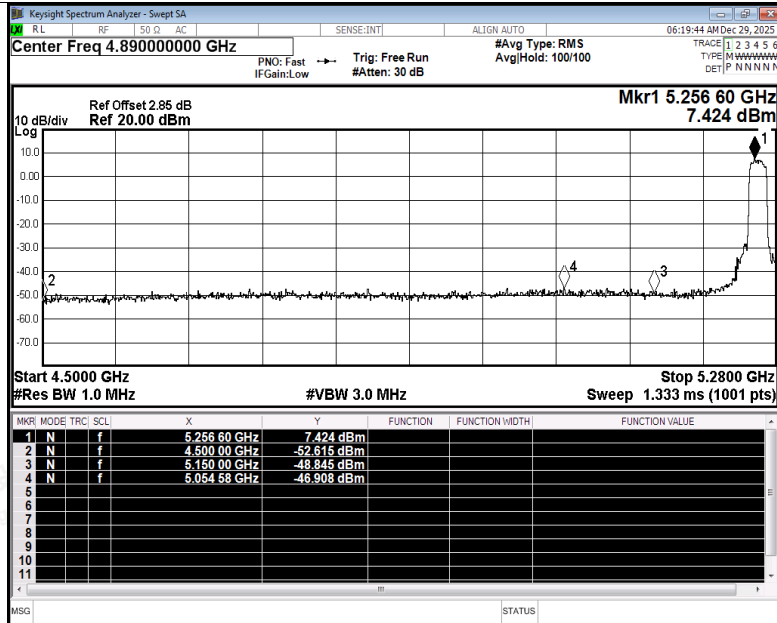

Restrict Band NVNT ac20 5260MHz Ant2 Peak

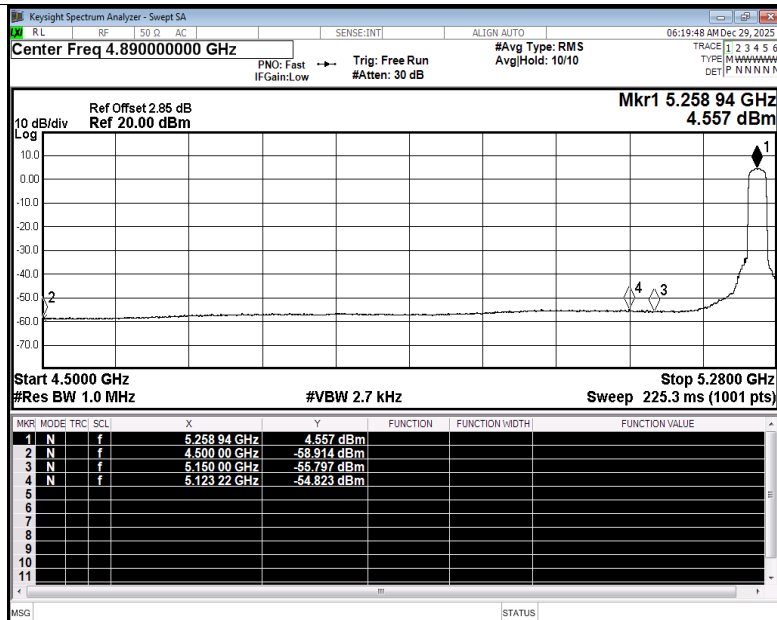

Restrict Band NVNT ac20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

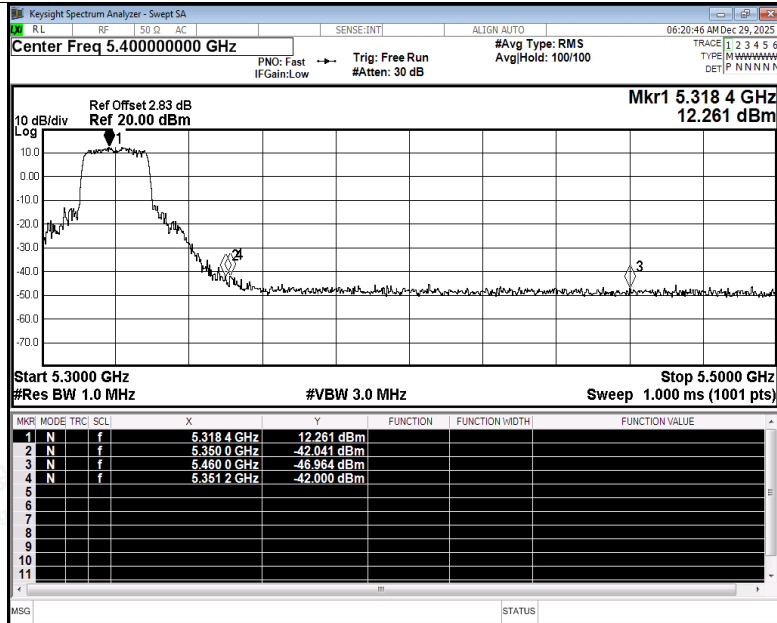

Restrict Band NVNT ac20 5320MHz Ant2 Peak

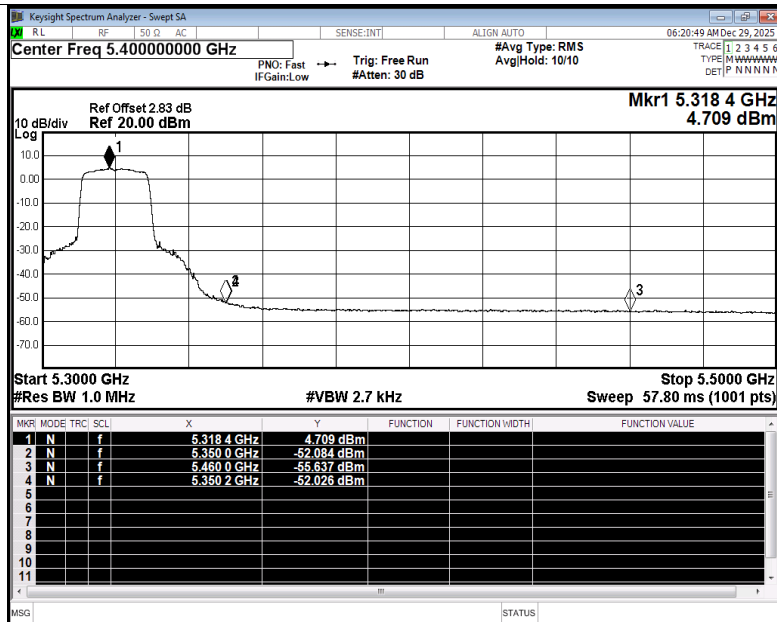

Restrict Band NVNT ac20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

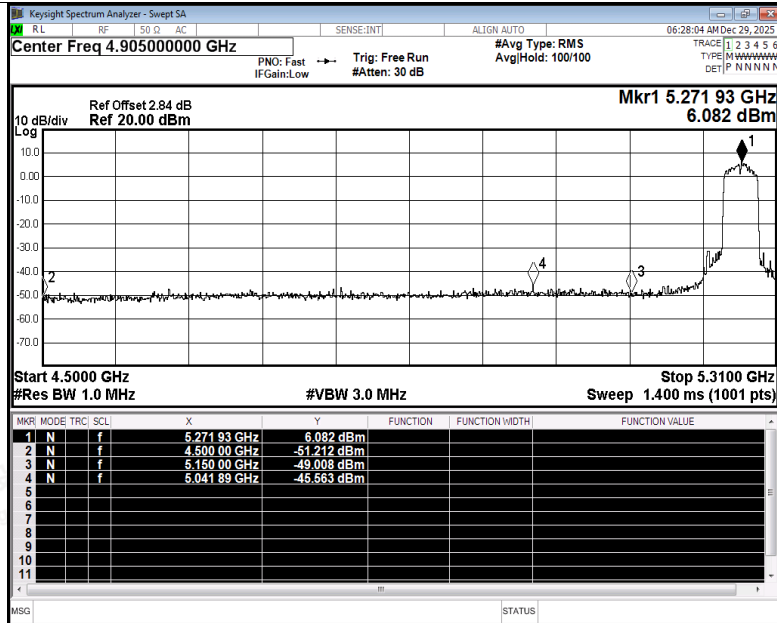

Restrict Band NVNT ac40 5270MHz Ant2 Peak

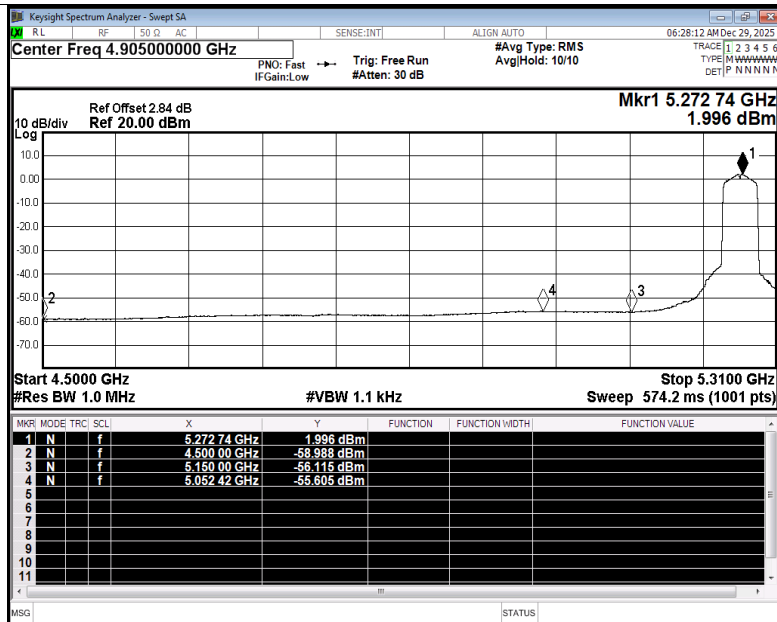

Restrict Band NVNT ac40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

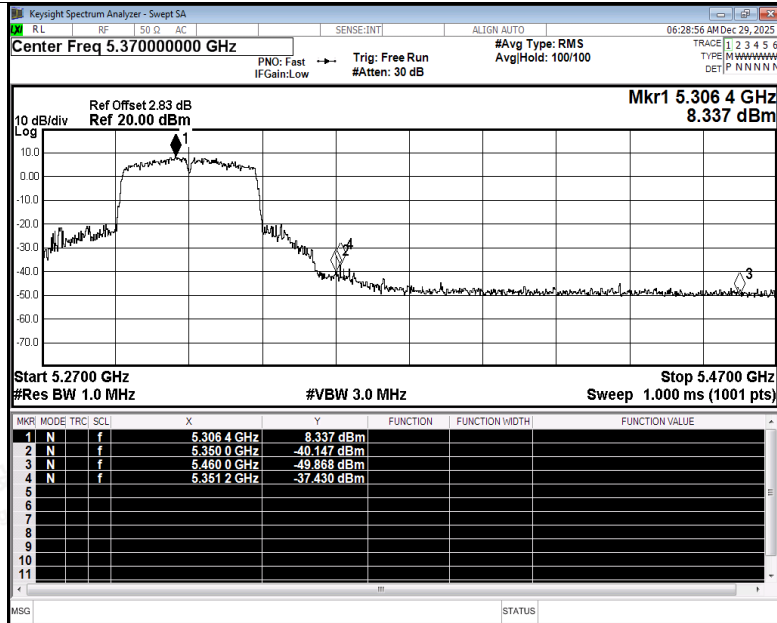

Restrict Band NVNT ac40 5310MHz Ant2 Peak

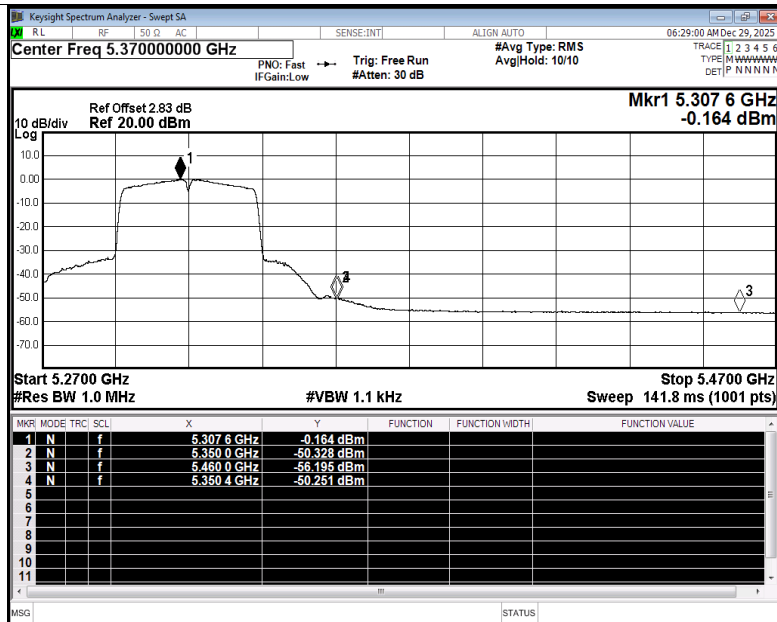

Restrict Band NVNT ac40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

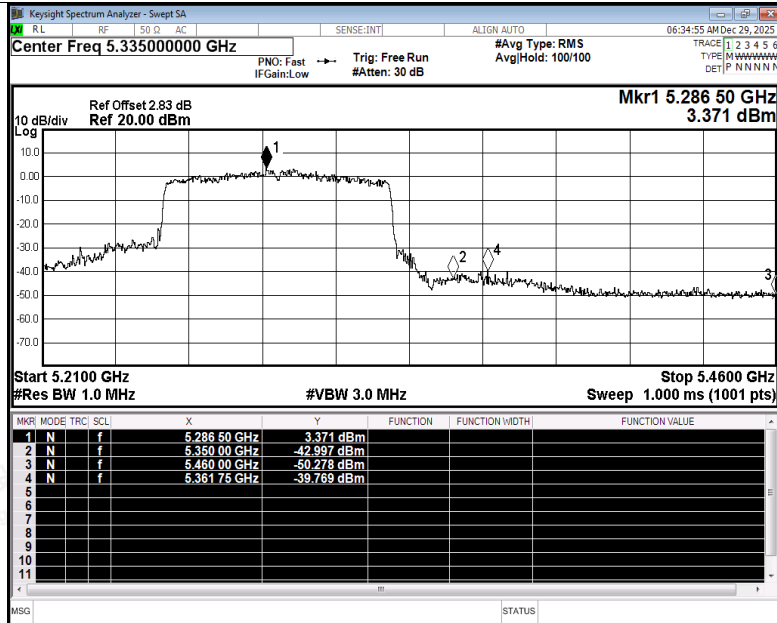


Restrict Band NVNT ac80 5290MHz Ant2 Peak

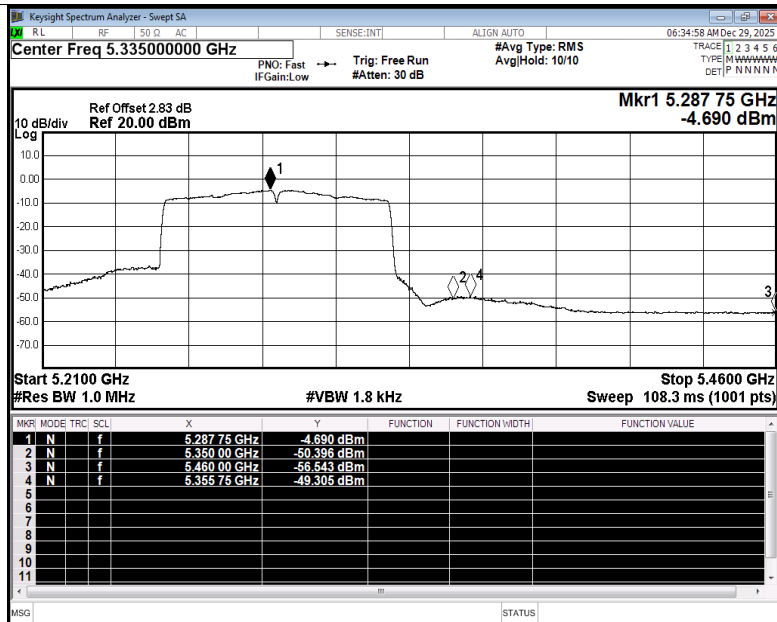


Restrict Band NVNT ac80 5290MHz Ant2 Average



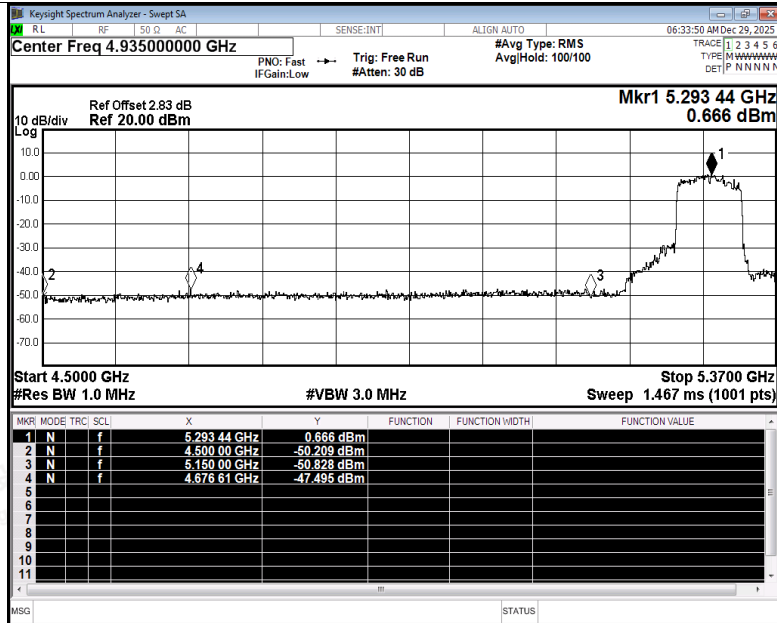

Restrict Band NVNT ac80 5290MHz Ant2 Peak

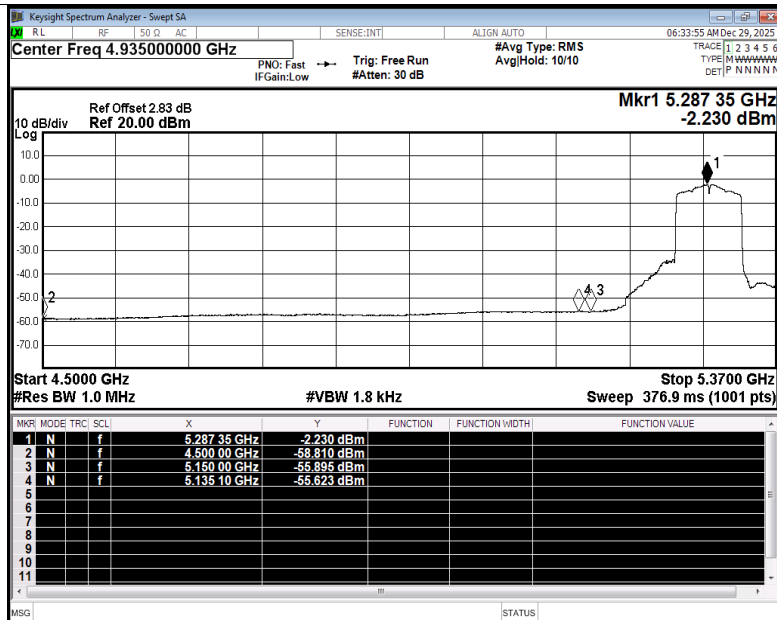

Restrict Band NVNT ac80 5290MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

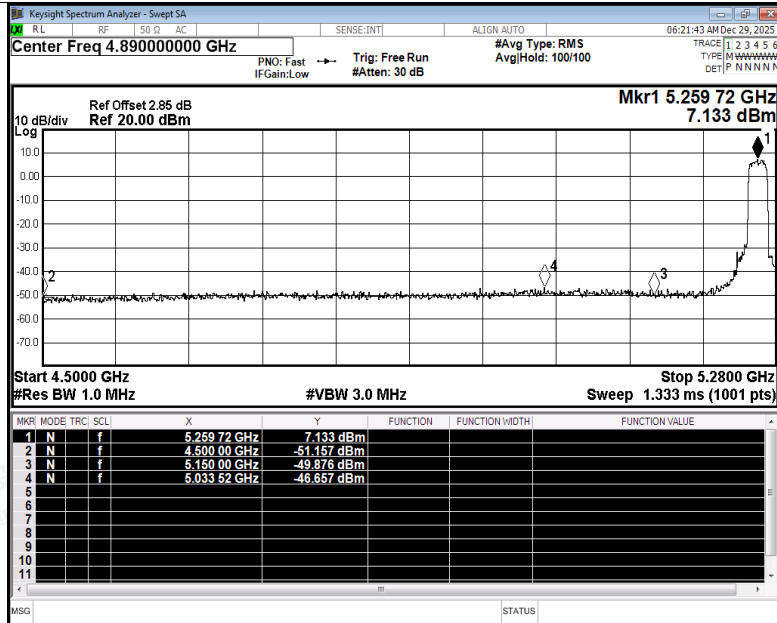

Restrict Band NVNT ax20 5260MHz Ant2 Peak

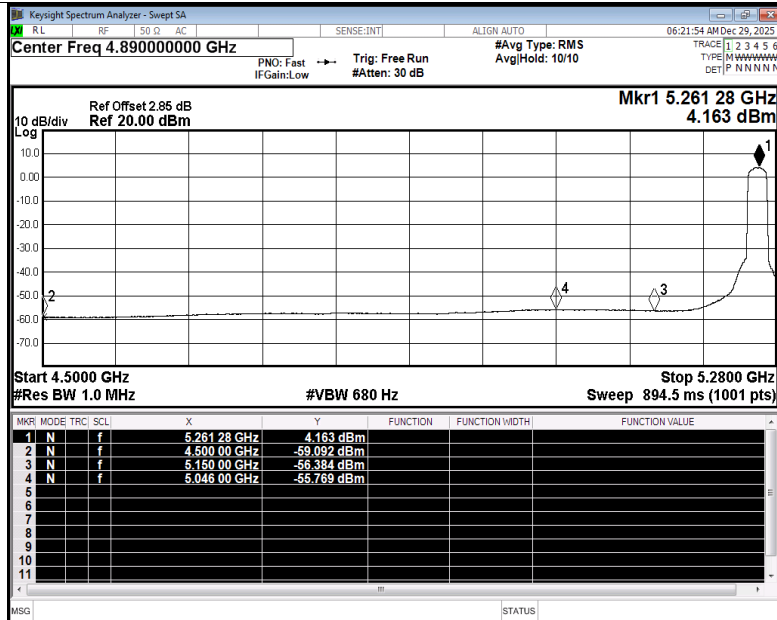

Restrict Band NVNT ax20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

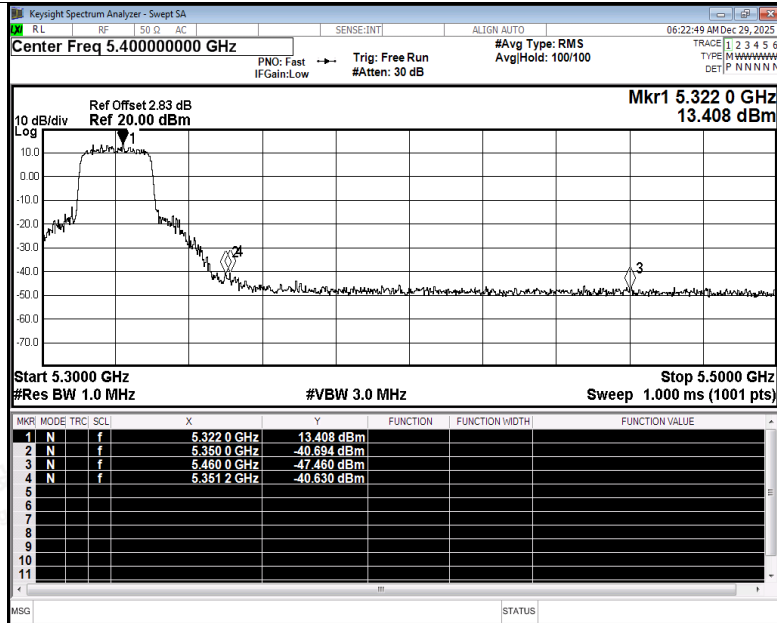

Restrict Band NVNT ax20 5320MHz Ant2 Peak

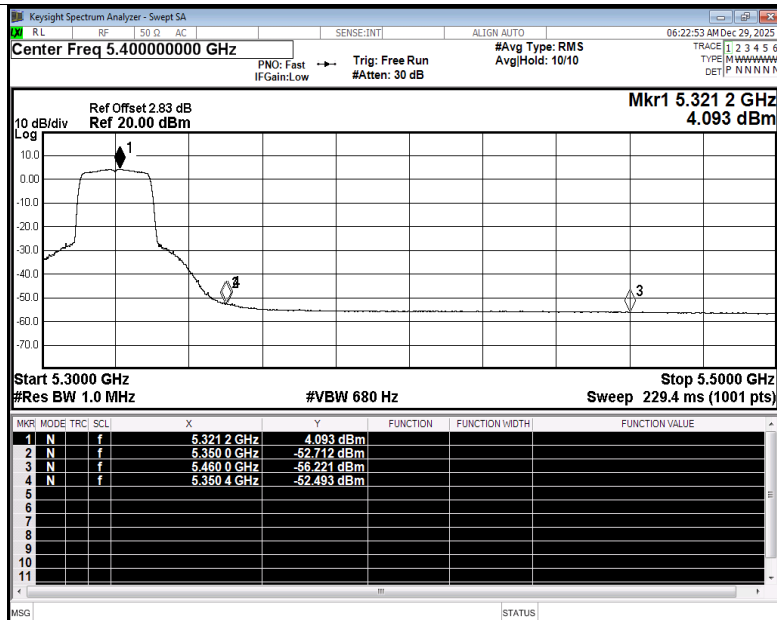

Restrict Band NVNT ax20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

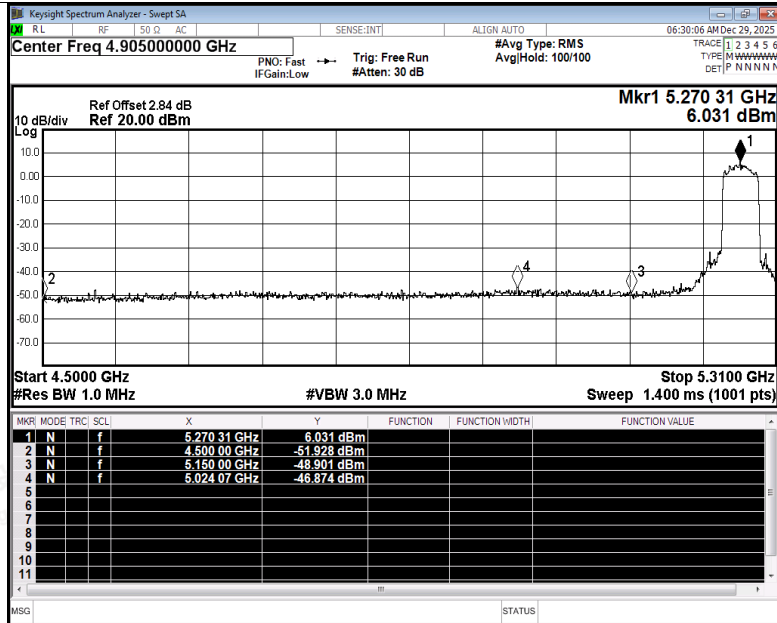

Restrict Band NVNT ax40 5270MHz Ant2 Peak

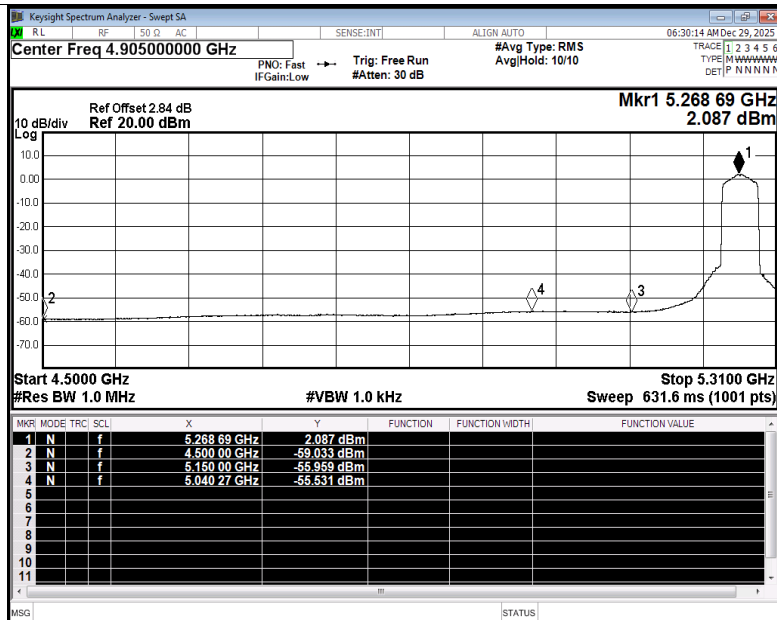

Restrict Band NVNT ax40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

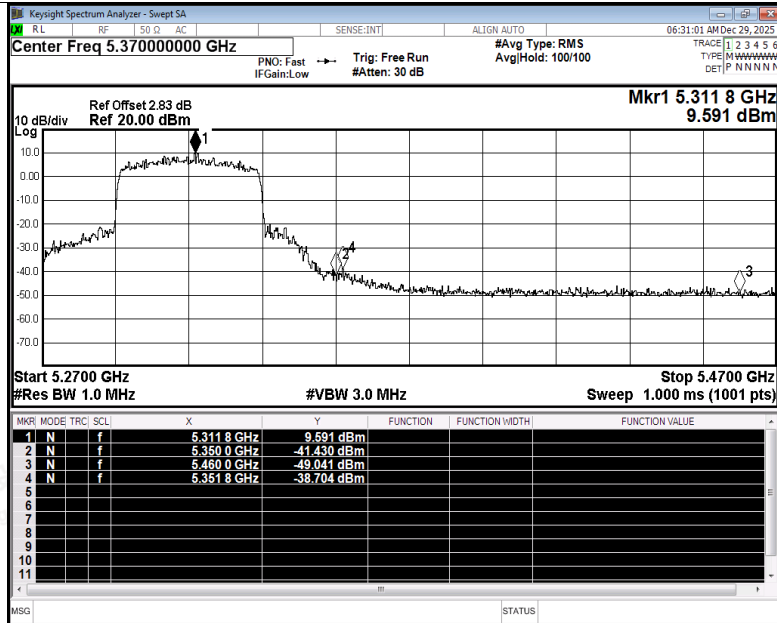

Restrict Band NVNT ax40 5310MHz Ant2 Peak

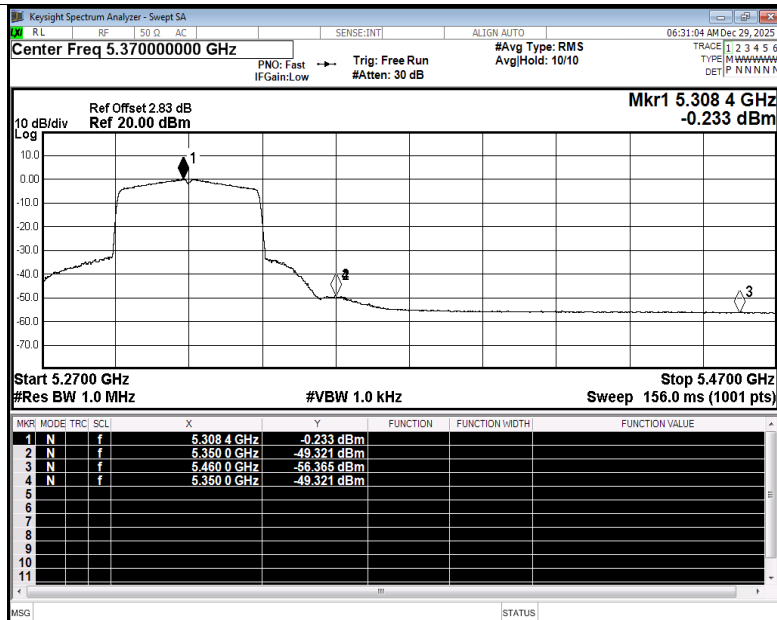

Restrict Band NVNT ax40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

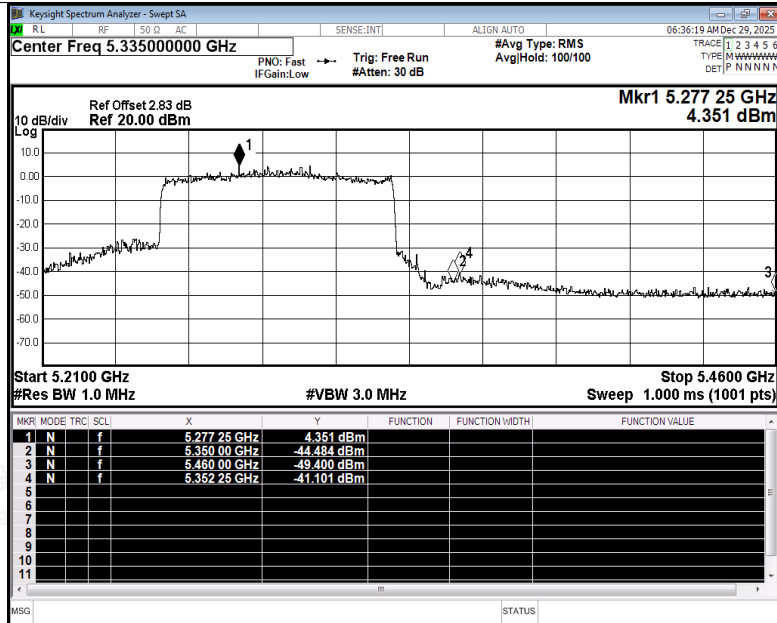

Restrict Band NVNT ax80 5290MHz Ant2 Peak

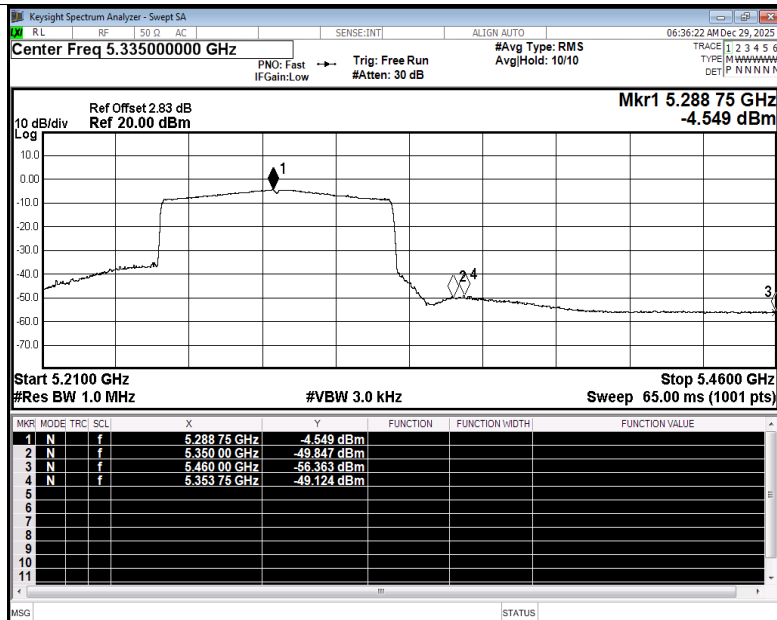

Restrict Band NVNT ax80 5290MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

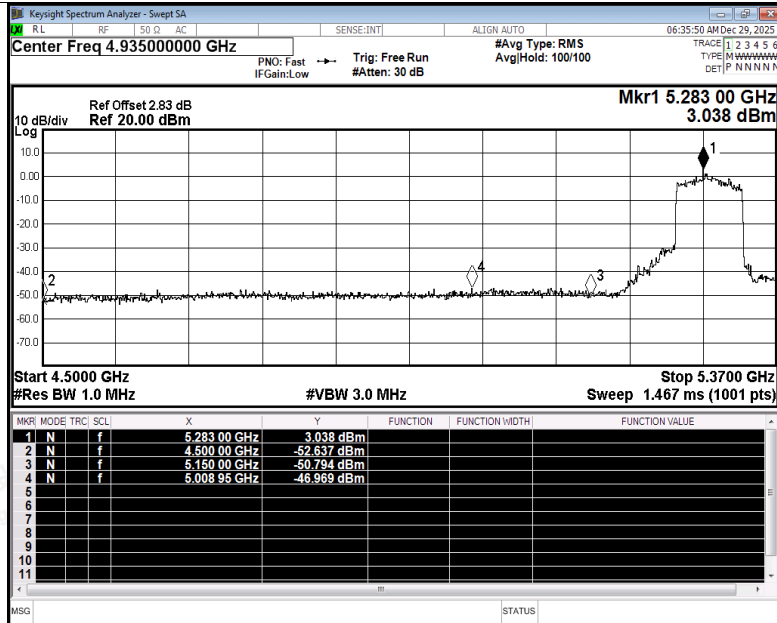

Restrict Band NVNT ax80 5290MHz Ant2 Peak

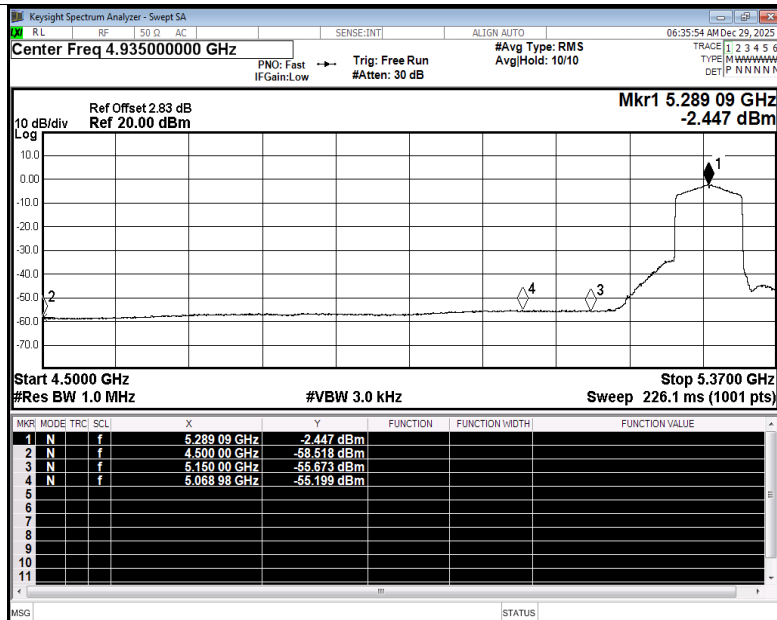

Restrict Band NVNT ax80 5290MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

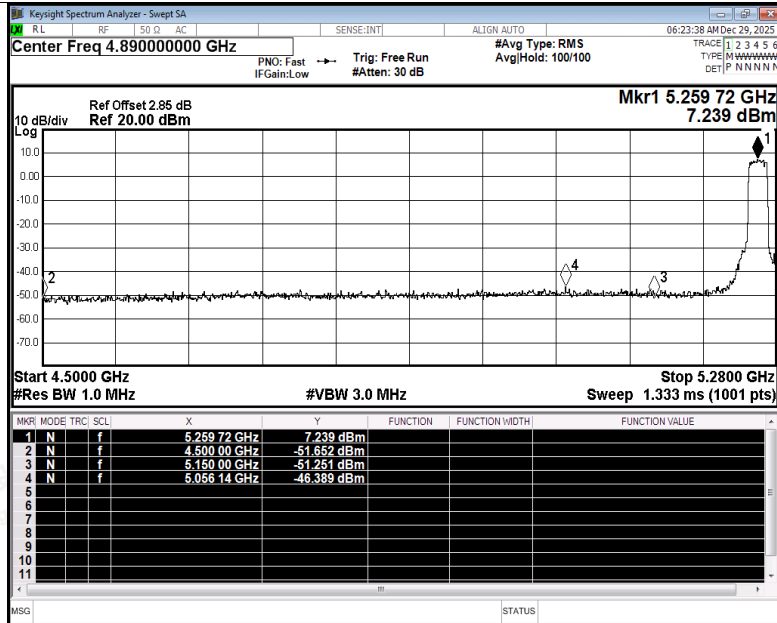

Restrict Band NVNT be20 5260MHz Ant2 Peak

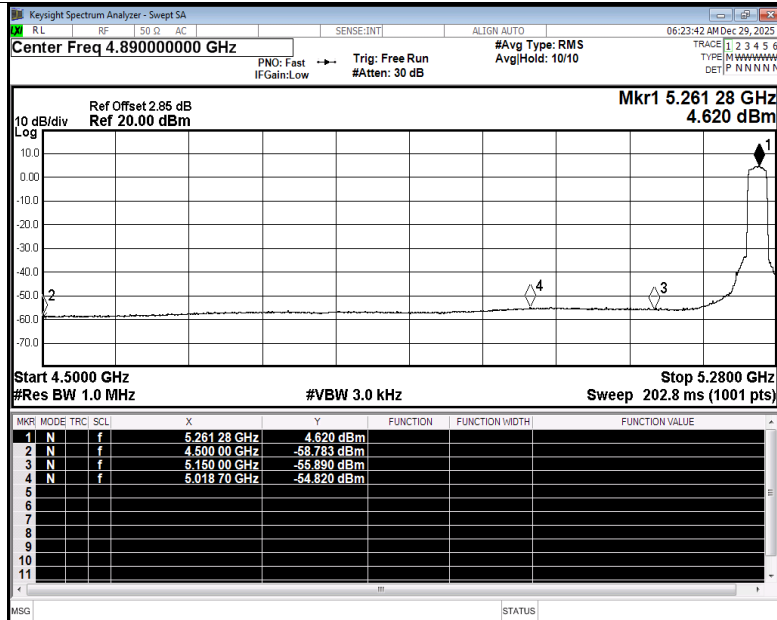

Restrict Band NVNT be20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

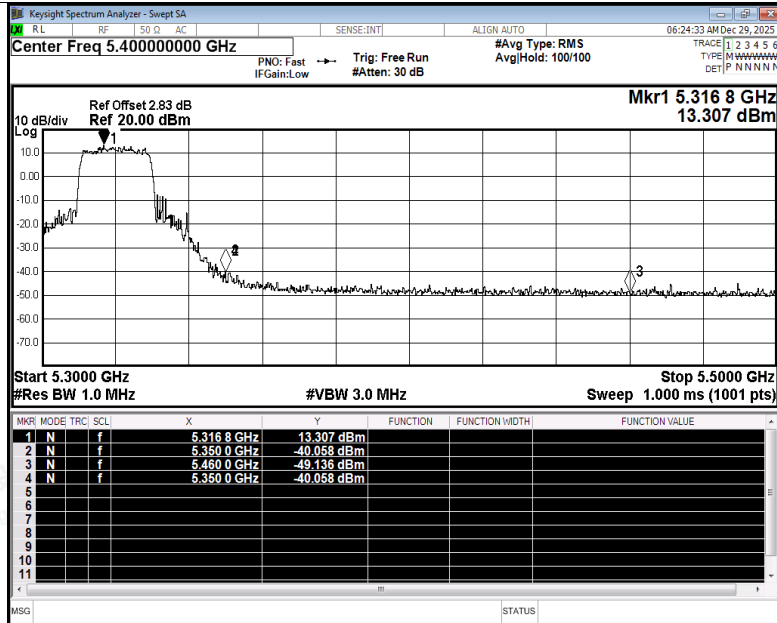

Restrict Band NVNT be20 5320MHz Ant2 Peak

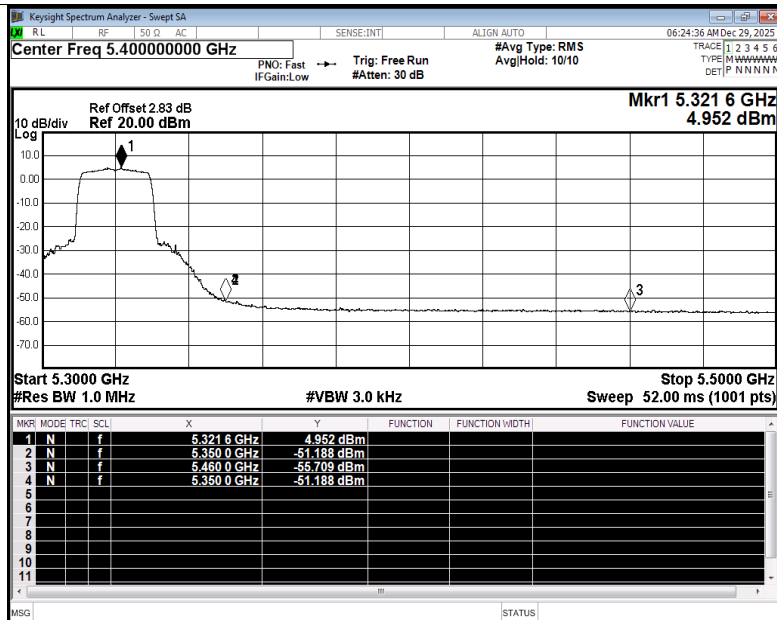

Restrict Band NVNT be20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

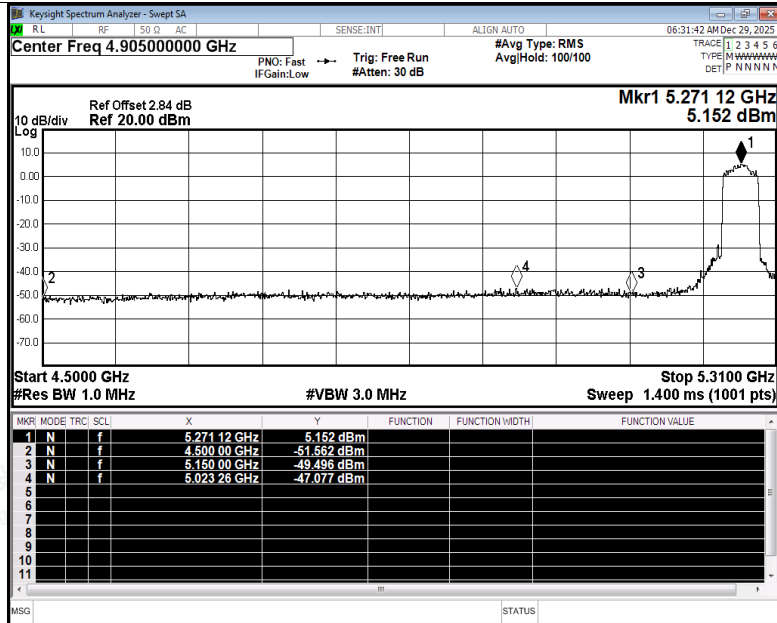

Restrict Band NVNT be40 5270MHz Ant2 Peak

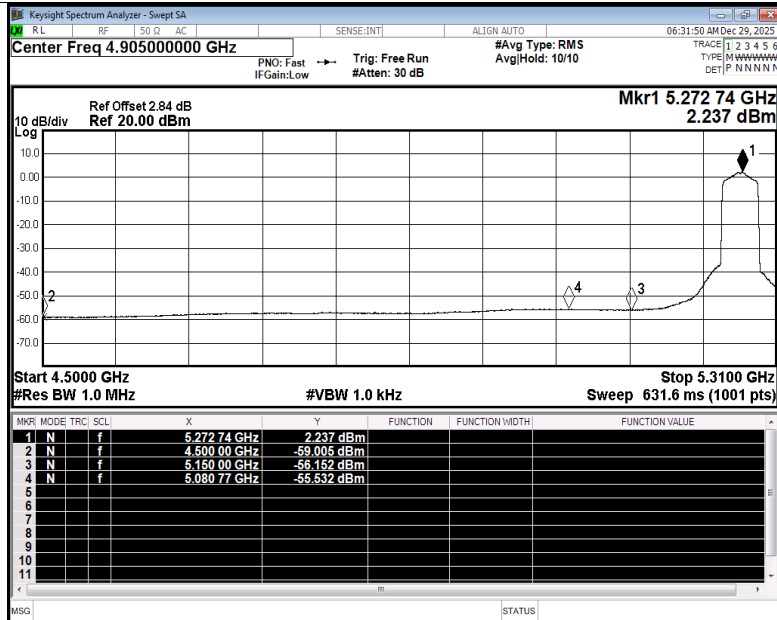

Restrict Band NVNT be40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

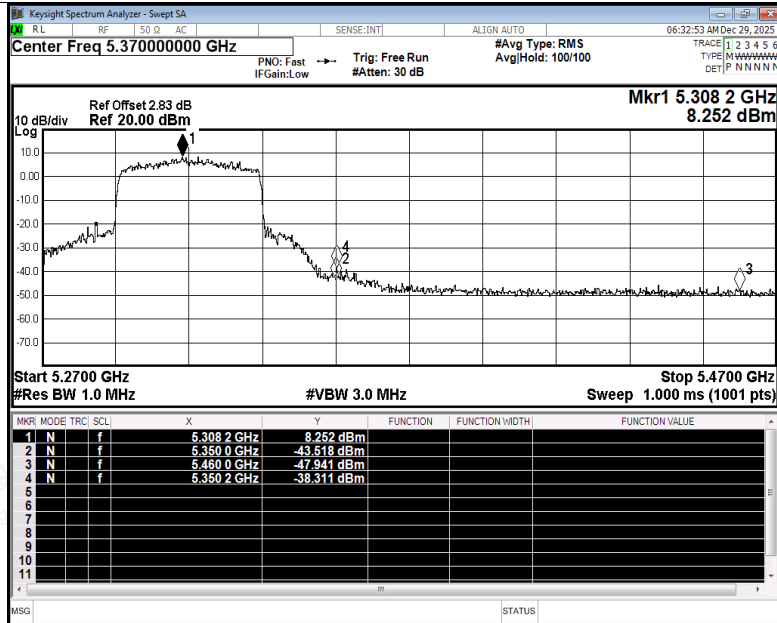

Restrict Band NVNT be40 5310MHz Ant2 Peak

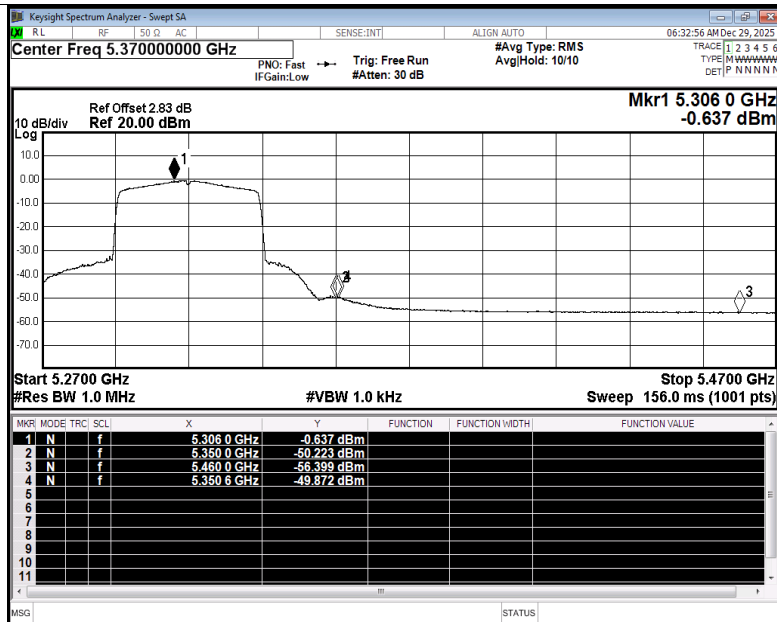

Restrict Band NVNT be40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

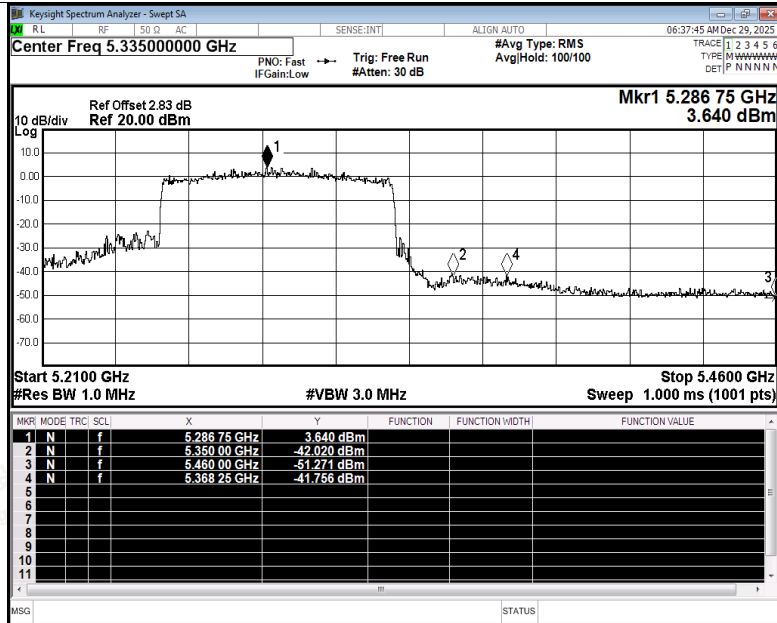

Restrict Band NVNT be80 5290MHz Ant2 Peak

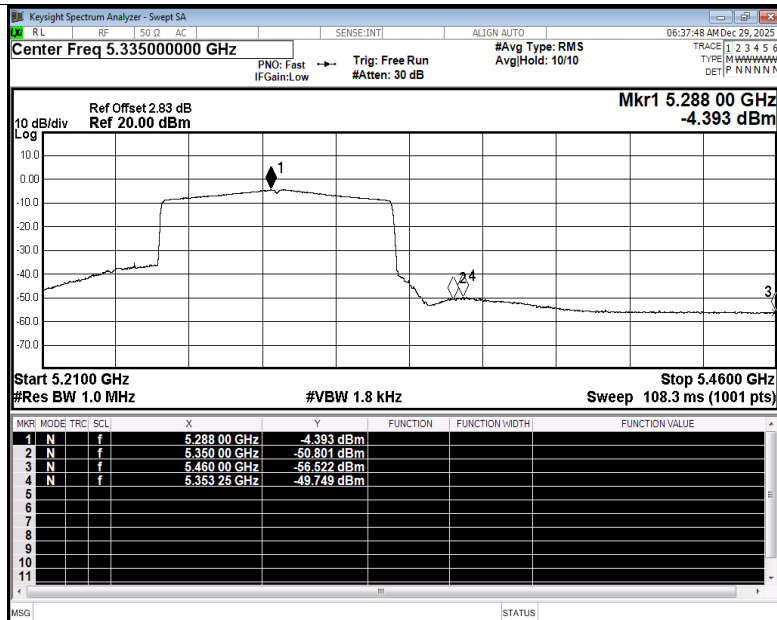

Restrict Band NVNT be80 5290MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

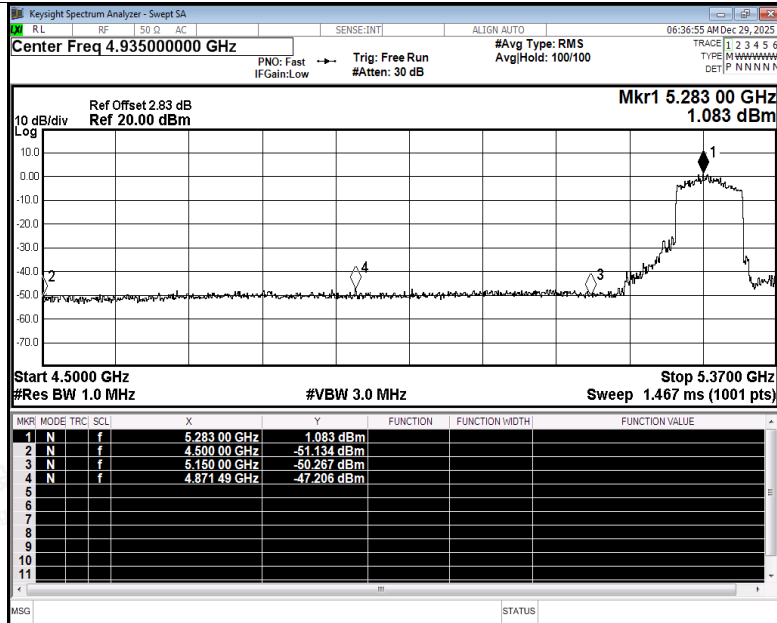

Restrict Band NVNT be80 5290MHz Ant2 Peak

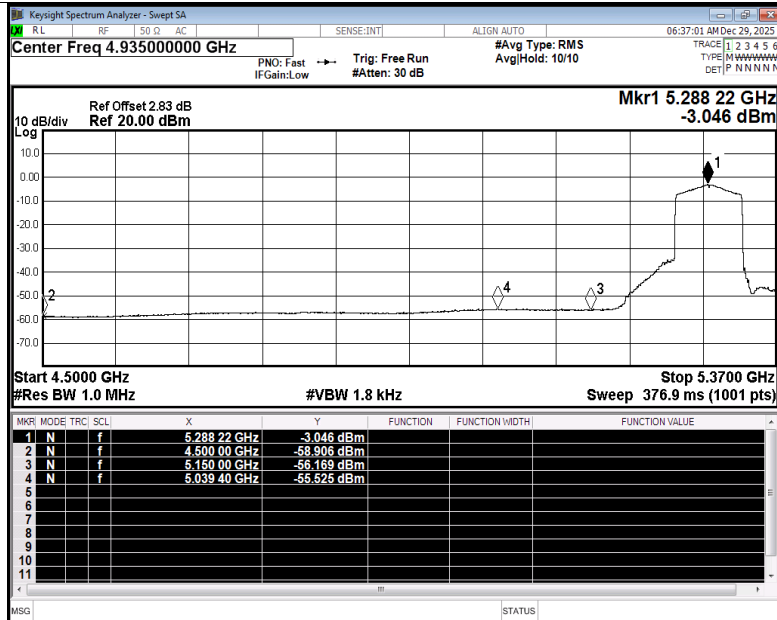

Restrict Band NVNT be80 5290MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant3	4500	-49.99	6.6	51.84	Peak	68.2	Pass
NVNT	a	5260	Ant3	4500	-59.15	6.6	42.68	Average	54	Pass
NVNT	a	5260	Ant3	5049.12	-47.09	6.6	54.74	Peak	68.2	Pass
NVNT	a	5260	Ant3	5121.66	-55.81	6.6	46.02	Average	54	Pass
NVNT	a	5260	Ant3	5150	-48.62	6.6	53.21	Peak	68.2	Pass
NVNT	a	5260	Ant3	5150	-56.46	6.6	45.37	Average	54	Pass
NVNT	a	5320	Ant3	5350	-41.96	6.6	59.87	Peak	68.2	Pass
NVNT	a	5320	Ant3	5350	-51.02	6.6	50.81	Average	54	Pass
NVNT	a	5320	Ant3	5352.8	-39.71	6.6	62.12	Peak	68.2	Pass
NVNT	a	5320	Ant3	5350	-51.02	6.6	50.81	Average	54	Pass
NVNT	a	5320	Ant3	5460	-48.52	6.6	53.31	Peak	68.2	Pass
NVNT	a	5320	Ant3	5460	-57.04	6.6	44.79	Average	54	Pass
NVNT	n20	5260	Ant3	4500	-52.06	6.6	49.77	Peak	68.2	Pass
NVNT	n20	5260	Ant3	4500	-58.99	6.6	42.84	Average	54	Pass
NVNT	n20	5260	Ant3	5104.5	-46.79	6.6	55.04	Peak	68.2	Pass
NVNT	n20	5260	Ant3	5051.46	-55.9	6.6	45.93	Average	54	Pass
NVNT	n20	5260	Ant3	5150	-48.34	6.6	53.49	Peak	68.2	Pass
NVNT	n20	5260	Ant3	5150	-56.47	6.6	45.36	Average	54	Pass
NVNT	n20	5320	Ant3	5350	-40.4	6.6	61.43	Peak	68.2	Pass
NVNT	n20	5320	Ant3	5350	-50.6	6.6	51.23	Average	54	Pass
NVNT	n20	5320	Ant3	5351	-37.29	6.6	64.54	Peak	68.2	Pass
NVNT	n20	5320	Ant3	5350	-50.6	6.6	51.23	Average	54	Pass
NVNT	n20	5320	Ant3	5460	-49.37	6.6	52.46	Peak	68.2	Pass
NVNT	n20	5320	Ant3	5460	-56.92	6.6	44.91	Average	54	Pass
NVNT	n40	5270	Ant3	4500	-51.72	6.6	50.11	Peak	68.2	Pass
NVNT	n40	5270	Ant3	4500	-58.73	6.6	43.1	Average	54	Pass
NVNT	n40	5270	Ant3	5118.84	-46.86	6.6	54.97	Peak	68.2	Pass
NVNT	n40	5270	Ant3	5050.8	-55.49	6.6	46.34	Average	54	Pass
NVNT	n40	5270	Ant3	5150	-48.81	6.6	53.02	Peak	68.2	Pass
NVNT	n40	5270	Ant3	5150	-55.84	6.6	45.99	Average	54	Pass
NVNT	n40	5310	Ant3	5350	-40.57	6.6	61.26	Peak	68.2	Pass
NVNT	n40	5310	Ant3	5350	-49.27	6.6	52.56	Average	54	Pass
NVNT	n40	5310	Ant3	5351.2	-38.65	6.6	63.18	Peak	68.2	Pass
NVNT	n40	5310	Ant3	5350	-49.27	6.6	52.56	Average	54	Pass
NVNT	n40	5310	Ant3	5460	-49.13	6.6	52.7	Peak	68.2	Pass
NVNT	n40	5310	Ant3	5460	-56.88	6.6	44.95	Average	54	Pass
NVNT	ac20	5260	Ant3	4500	-52.41	6.6	49.42	Peak	68.2	Pass
NVNT	ac20	5260	Ant3	4500	-58.68	6.6	43.15	Average	54	Pass
NVNT	ac20	5260	Ant3	5145.06	-46.61	6.6	55.22	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant3	5038.98	-55.13	6.6	46.7	Average	54	Pass
NVNT	ac20	5260	Ant3	5150	-49.78	6.6	52.05	Peak	68.2	Pass
NVNT	ac20	5260	Ant3	5150	-55.7	6.6	46.13	Average	54	Pass
NVNT	ac20	5320	Ant3	5350	-42.55	6.6	59.28	Peak	68.2	Pass
NVNT	ac20	5320	Ant3	5350	-49.96	6.6	51.87	Average	54	Pass
NVNT	ac20	5320	Ant3	5353.4	-37.88	6.6	63.95	Peak	68.2	Pass
NVNT	ac20	5320	Ant3	5351	-48.87	6.6	52.96	Average	54	Pass
NVNT	ac20	5320	Ant3	5460	-47.36	6.6	54.47	Peak	68.2	Pass
NVNT	ac20	5320	Ant3	5460	-56.29	6.6	45.54	Average	54	Pass
NVNT	ac40	5270	Ant3	4500	-52.43	6.6	49.4	Peak	68.2	Pass
NVNT	ac40	5270	Ant3	4500	-58.88	6.6	42.95	Average	54	Pass
NVNT	ac40	5270	Ant3	5001.39	-46.42	6.6	55.41	Peak	68.2	Pass
NVNT	ac40	5270	Ant3	5030.55	-55.6	6.6	46.23	Average	54	Pass
NVNT	ac40	5270	Ant3	5150	-49.61	6.6	52.22	Peak	68.2	Pass
NVNT	ac40	5270	Ant3	5150	-55.72	6.6	46.11	Average	54	Pass
NVNT	ac40	5310	Ant3	5350	-43.06	6.6	58.77	Peak	68.2	Pass
NVNT	ac40	5310	Ant3	5350	-50.04	6.6	51.79	Average	54	Pass
NVNT	ac40	5310	Ant3	5351	-40.11	6.6	61.72	Peak	68.2	Pass
NVNT	ac40	5310	Ant3	5350	-50.04	6.6	51.79	Average	54	Pass
NVNT	ac40	5310	Ant3	5460	-49.88	6.6	51.95	Peak	68.2	Pass
NVNT	ac40	5310	Ant3	5460	-56.98	6.6	44.85	Average	54	Pass
NVNT	ac80	5290	Ant3	5350	-43.48	6.6	58.35	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5350	-50.2	6.6	51.63	Average	54	Pass
NVNT	ac80	5290	Ant3	5357.25	-39.54	6.6	62.29	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5352.5	-49.43	6.6	52.4	Average	54	Pass
NVNT	ac80	5290	Ant3	5460	-50.9	6.6	50.93	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5460	-56.93	6.6	44.9	Average	54	Pass
NVNT	ac80	5290	Ant3	4500	-53.17	6.6	48.66	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	4500	-58.56	6.6	43.27	Average	54	Pass
NVNT	ac80	5290	Ant3	5101.17	-47.26	6.6	54.57	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5149.02	-55.5	6.6	46.33	Average	54	Pass
NVNT	ac80	5290	Ant3	5150	-50.42	6.6	51.41	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5150	-55.46	6.6	46.37	Average	54	Pass
NVNT	ax20	5260	Ant3	4500	-51.81	6.6	50.02	Peak	68.2	Pass
NVNT	ax20	5260	Ant3	4500	-58.52	6.6	43.31	Average	54	Pass
NVNT	ax20	5260	Ant3	5025.72	-47.23	6.6	54.6	Peak	68.2	Pass
NVNT	ax20	5260	Ant3	5026.5	-55.19	6.6	46.64	Average	54	Pass
NVNT	ax20	5260	Ant3	5150	-49.93	6.6	51.9	Peak	68.2	Pass
NVNT	ax20	5260	Ant3	5150	-55.86	6.6	45.97	Average	54	Pass
NVNT	ax20	5320	Ant3	5350	-40.29	6.6	61.54	Peak	68.2	Pass
NVNT	ax20	5320	Ant3	5350	-49.77	6.6	52.06	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant3	5352	-39.94	6.6	61.89	Peak	68.2	Pass
NVNT	ax20	5320	Ant3	5350	-49.77	6.6	52.06	Average	54	Pass
NVNT	ax20	5320	Ant3	5460	-49.6	6.6	52.23	Peak	68.2	Pass
NVNT	ax20	5320	Ant3	5460	-56.41	6.6	45.42	Average	54	Pass
NVNT	ax40	5270	Ant3	4500	-53.29	6.6	48.54	Peak	68.2	Pass
NVNT	ax40	5270	Ant3	4500	-58.29	6.6	43.54	Average	54	Pass
NVNT	ax40	5270	Ant3	5124.51	-46.85	6.6	54.98	Peak	68.2	Pass
NVNT	ax40	5270	Ant3	5032.17	-55.29	6.6	46.54	Average	54	Pass
NVNT	ax40	5270	Ant3	5150	-48.66	6.6	53.17	Peak	68.2	Pass
NVNT	ax40	5270	Ant3	5150	-55.55	6.6	46.28	Average	54	Pass
NVNT	ax40	5310	Ant3	5350	-40.88	6.6	60.95	Peak	68.2	Pass
NVNT	ax40	5310	Ant3	5350	-50.08	6.6	51.75	Average	54	Pass
NVNT	ax40	5310	Ant3	5350.8	-40.53	6.6	61.3	Peak	68.2	Pass
NVNT	ax40	5310	Ant3	5351	-49.78	6.6	52.05	Average	54	Pass
NVNT	ax40	5310	Ant3	5460	-50.34	6.6	51.49	Peak	68.2	Pass
NVNT	ax40	5310	Ant3	5460	-56.88	6.6	44.95	Average	54	Pass
NVNT	ax80	5290	Ant3	5350	-42.17	6.6	59.66	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5350	-49.39	6.6	52.44	Average	54	Pass
NVNT	ax80	5290	Ant3	5350.5	-40.56	6.6	61.27	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5352	-48.91	6.6	52.92	Average	54	Pass
NVNT	ax80	5290	Ant3	5460	-50.61	6.6	51.22	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5460	-56.52	6.6	45.31	Average	54	Pass
NVNT	ax80	5290	Ant3	4500	-52.72	6.6	49.11	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	4500	-58.68	6.6	43.15	Average	54	Pass
NVNT	ax80	5290	Ant3	5054.19	-46.75	6.6	55.08	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5149.02	-55.27	6.6	46.56	Average	54	Pass
NVNT	ax80	5290	Ant3	5150	-49.68	6.6	52.15	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5150	-55.34	6.6	46.49	Average	54	Pass
NVNT	be20	5260	Ant3	4500	-51.57	6.6	50.26	Peak	68.2	Pass
NVNT	be20	5260	Ant3	4500	-58.5	6.6	43.33	Average	54	Pass
NVNT	be20	5260	Ant3	4722.3	-46.64	6.6	55.19	Peak	68.2	Pass
NVNT	be20	5260	Ant3	5031.96	-55.19	6.6	46.64	Average	54	Pass
NVNT	be20	5260	Ant3	5150	-48.26	6.6	53.57	Peak	68.2	Pass
NVNT	be20	5260	Ant3	5150	-55.83	6.6	46	Average	54	Pass
NVNT	be20	5320	Ant3	5350	-38	6.6	63.83	Peak	68.2	Pass
NVNT	be20	5320	Ant3	5350	-49.5	6.6	52.33	Average	54	Pass
NVNT	be20	5320	Ant3	5354	-37.28	6.6	64.55	Peak	68.2	Pass
NVNT	be20	5320	Ant3	5350.4	-48.95	6.6	52.88	Average	54	Pass
NVNT	be20	5320	Ant3	5460	-50.89	6.6	50.94	Peak	68.2	Pass
NVNT	be20	5320	Ant3	5460	-56.37	6.6	45.46	Average	54	Pass
NVNT	be40	5270	Ant3	4500	-51.9	6.6	49.93	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5270	Ant3	4500	-58.96	6.6	42.87	Average	54	Pass
NVNT	be40	5270	Ant3	4806.99	-47.22	6.6	54.61	Peak	68.2	Pass
NVNT	be40	5270	Ant3	5036.22	-55.75	6.6	46.08	Average	54	Pass
NVNT	be40	5270	Ant3	5150	-49.99	6.6	51.84	Peak	68.2	Pass
NVNT	be40	5270	Ant3	5150	-55.73	6.6	46.1	Average	54	Pass
NVNT	be40	5310	Ant3	5350	-43.51	6.6	58.32	Peak	68.2	Pass
NVNT	be40	5310	Ant3	5350	-51.23	6.6	50.6	Average	54	Pass
NVNT	be40	5310	Ant3	5351.4	-41.89	6.6	59.94	Peak	68.2	Pass
NVNT	be40	5310	Ant3	5350.8	-50.48	6.6	51.35	Average	54	Pass
NVNT	be40	5310	Ant3	5460	-49.71	6.6	52.12	Peak	68.2	Pass
NVNT	be40	5310	Ant3	5460	-56.84	6.6	44.99	Average	54	Pass
NVNT	be80	5290	Ant3	5350	-43.65	6.6	58.18	Peak	68.2	Pass
NVNT	be80	5290	Ant3	5350	-50.6	6.6	51.23	Average	54	Pass
NVNT	be80	5290	Ant3	5353.75	-42.02	6.6	59.81	Peak	68.2	Pass
NVNT	be80	5290	Ant3	5350.5	-50.01	6.6	51.82	Average	54	Pass
NVNT	be80	5290	Ant3	5460	-50.29	6.6	51.54	Peak	68.2	Pass
NVNT	be80	5290	Ant3	5460	-56.76	6.6	45.07	Average	54	Pass
NVNT	be80	5290	Ant3	4500	-52.01	6.6	49.82	Peak	68.2	Pass
NVNT	be80	5290	Ant3	4500	-58.82	6.6	43.01	Average	54	Pass
NVNT	be80	5290	Ant3	5045.49	-47.78	6.6	54.05	Peak	68.2	Pass
NVNT	be80	5290	Ant3	5147.28	-55.26	6.6	46.57	Average	54	Pass
NVNT	be80	5290	Ant3	5150	-48.77	6.6	53.06	Peak	68.2	Pass
NVNT	be80	5290	Ant3	5150	-55.34	6.6	46.49	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

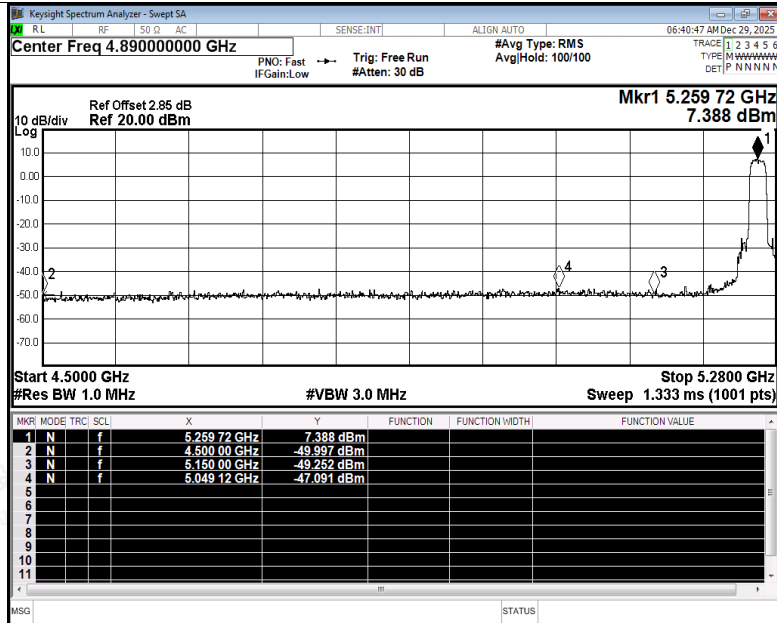

Restrict Band NVNT a 5260MHz Ant3 Peak

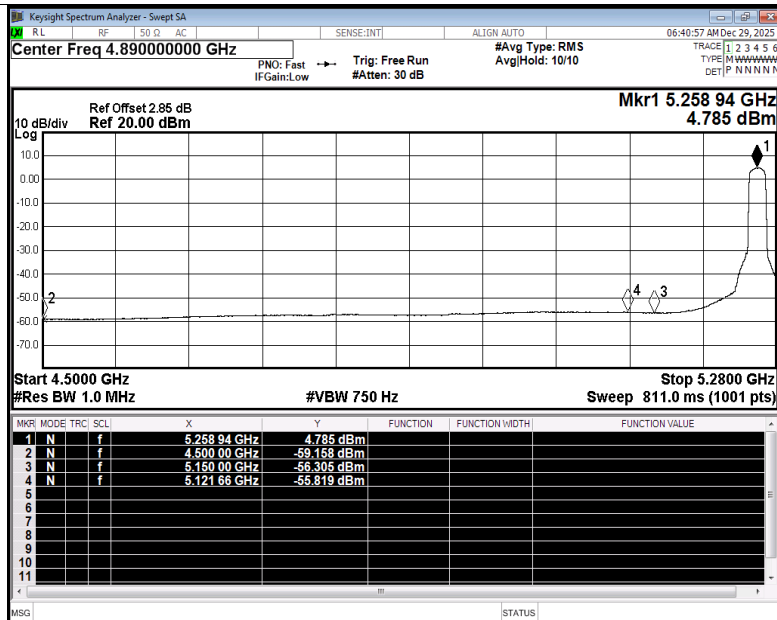

Restrict Band NVNT a 5260MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

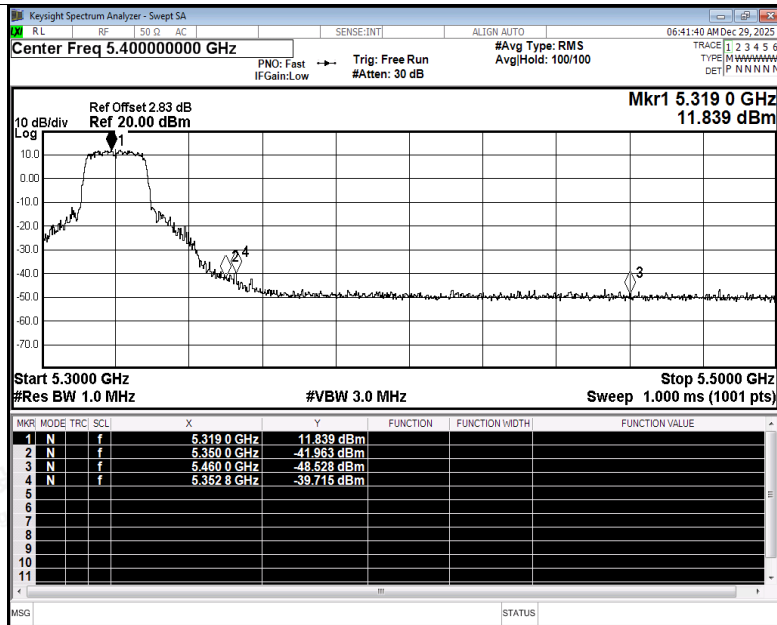

Restrict Band NVNT a 5320MHz Ant3 Peak

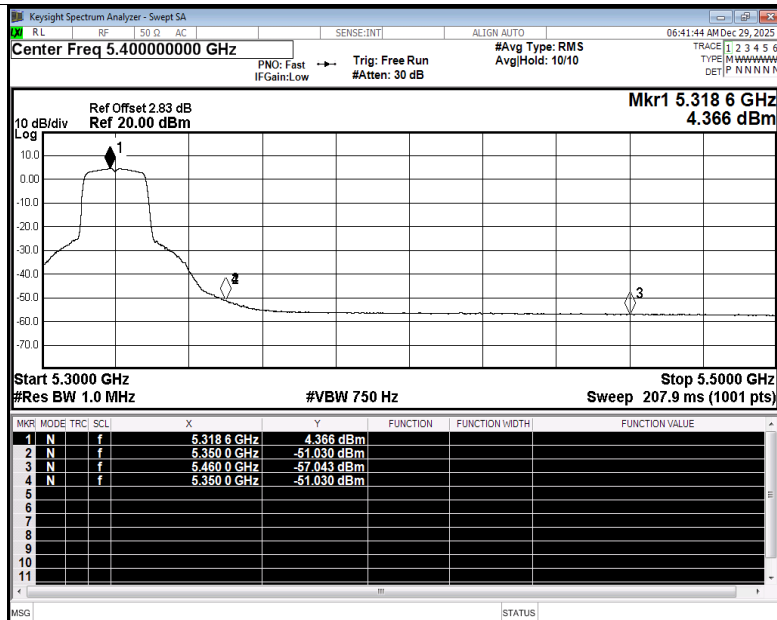

Restrict Band NVNT a 5320MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

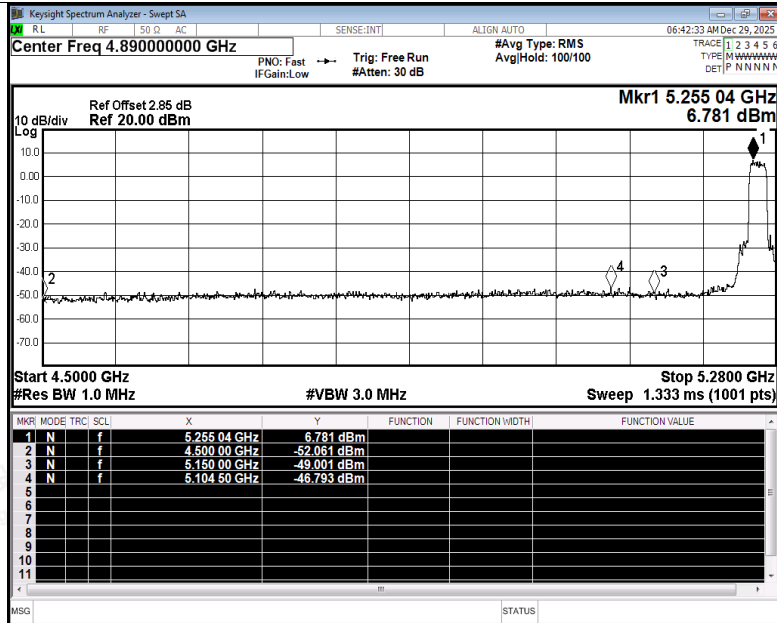

Restrict Band NVNT n20 5260MHz Ant3 Peak

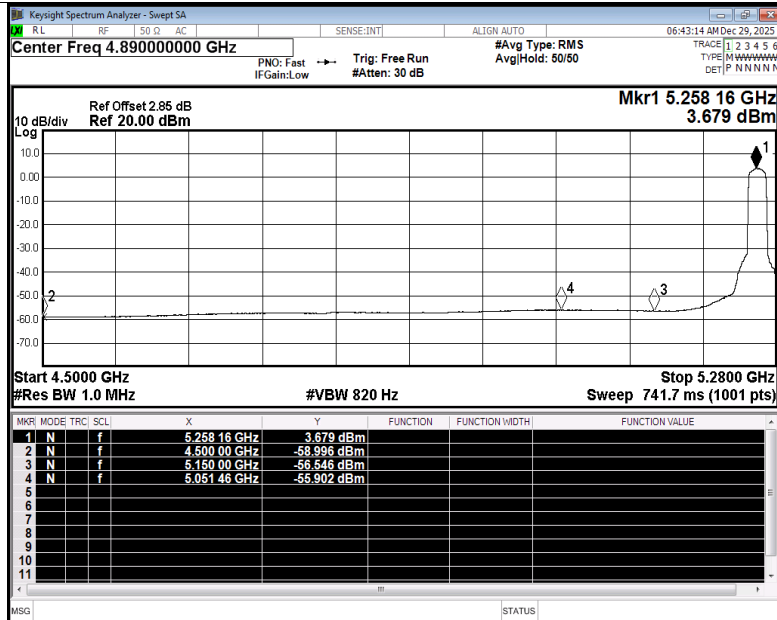

Restrict Band NVNT n20 5260MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

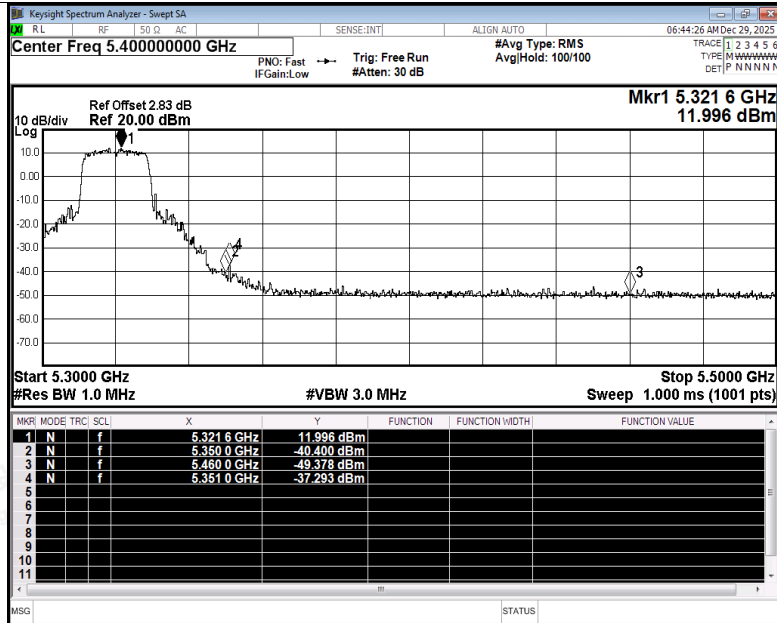

Restrict Band NVNT n20 5320MHz Ant3 Peak

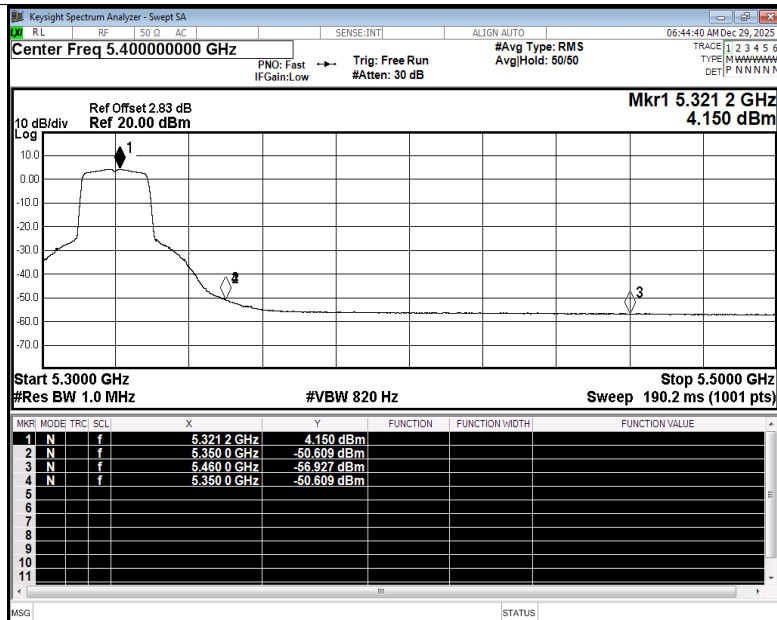

Restrict Band NVNT n20 5320MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

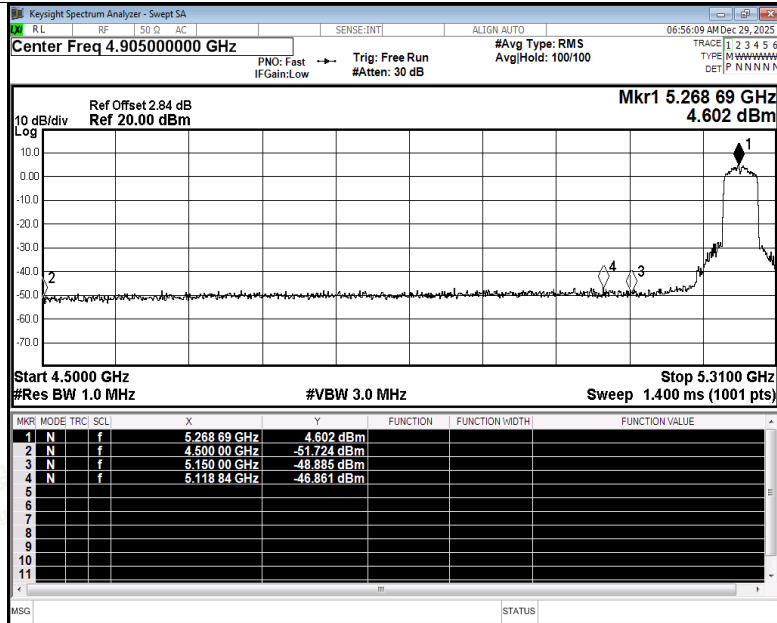

Restrict Band NVNT n40 5270MHz Ant3 Peak

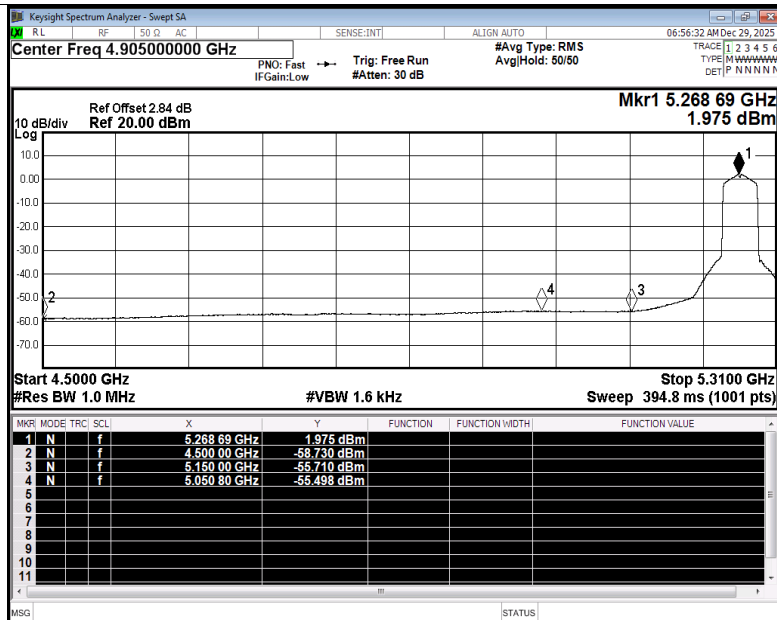

Restrict Band NVNT n40 5270MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

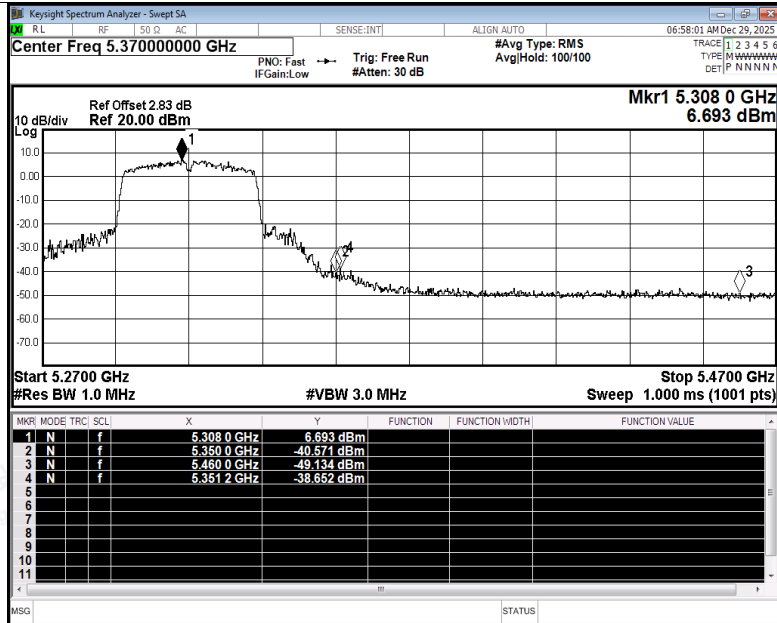


Restrict Band NVNT n40 5310MHz Ant3 Peak

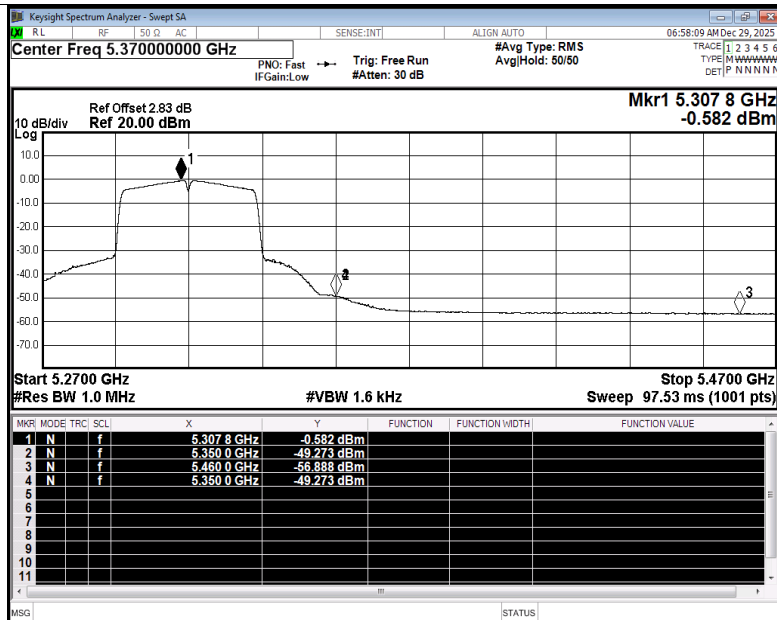


Restrict Band NVNT n40 5310MHz Ant3 Average



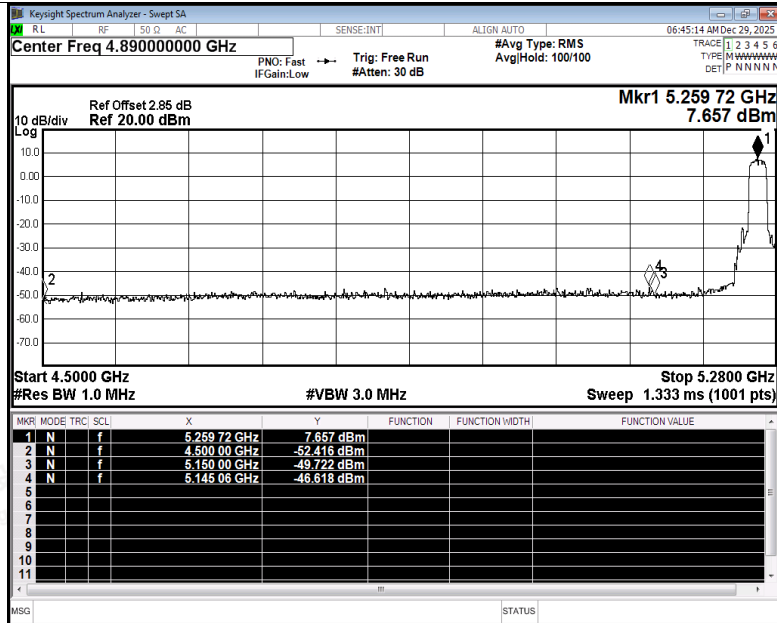

Restrict Band NVNT ac20 5260MHz Ant3 Peak

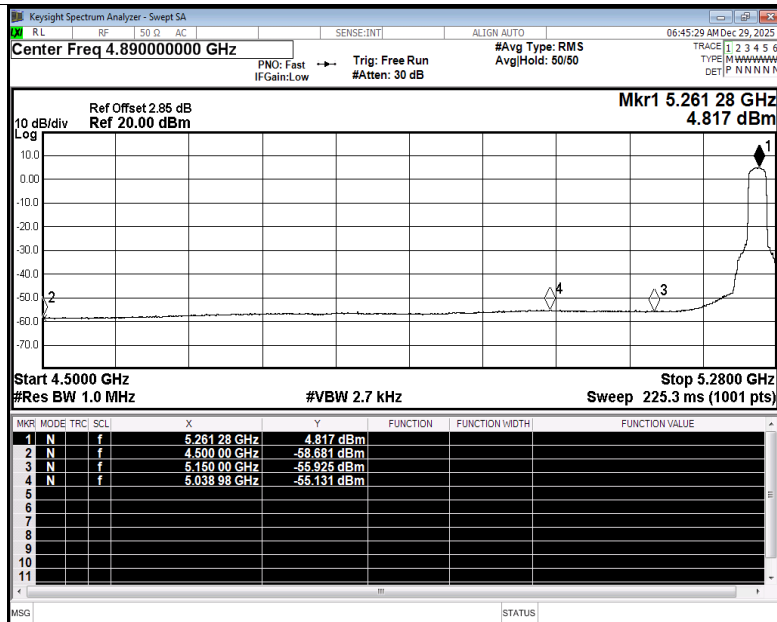

Restrict Band NVNT ac20 5260MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

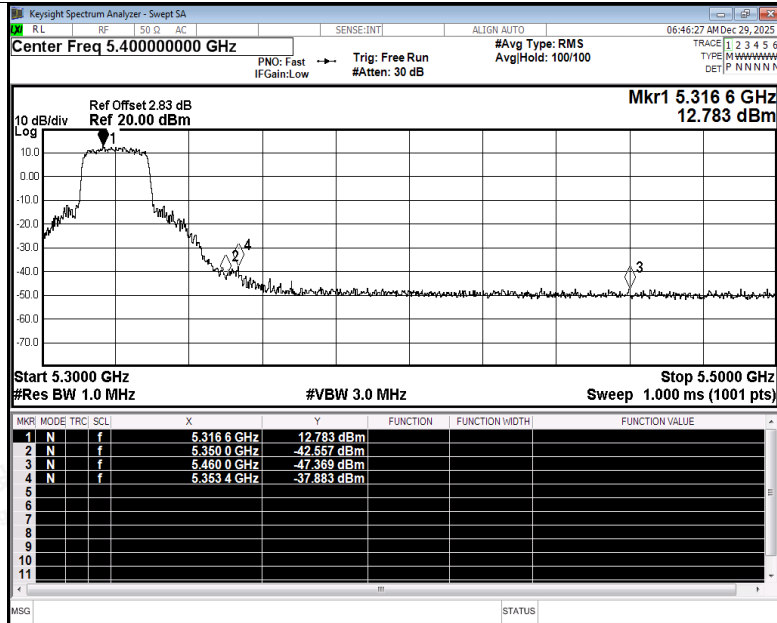

Restrict Band NVNT ac20 5320MHz Ant3 Peak

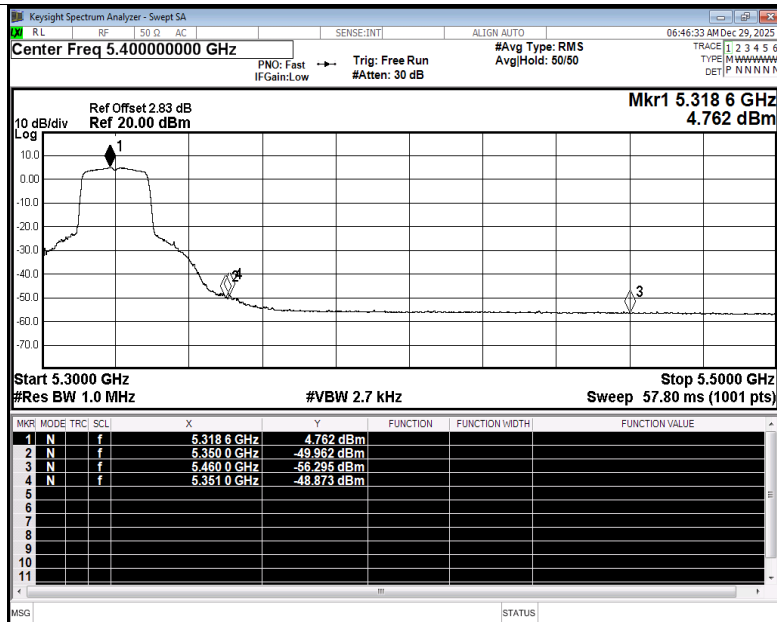

Restrict Band NVNT ac20 5320MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

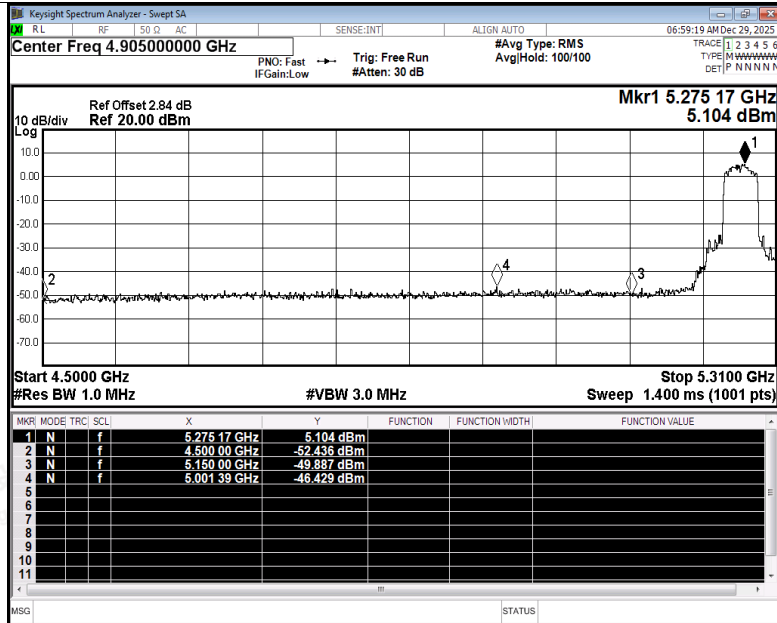

Restrict Band NVNT ac40 5270MHz Ant3 Peak

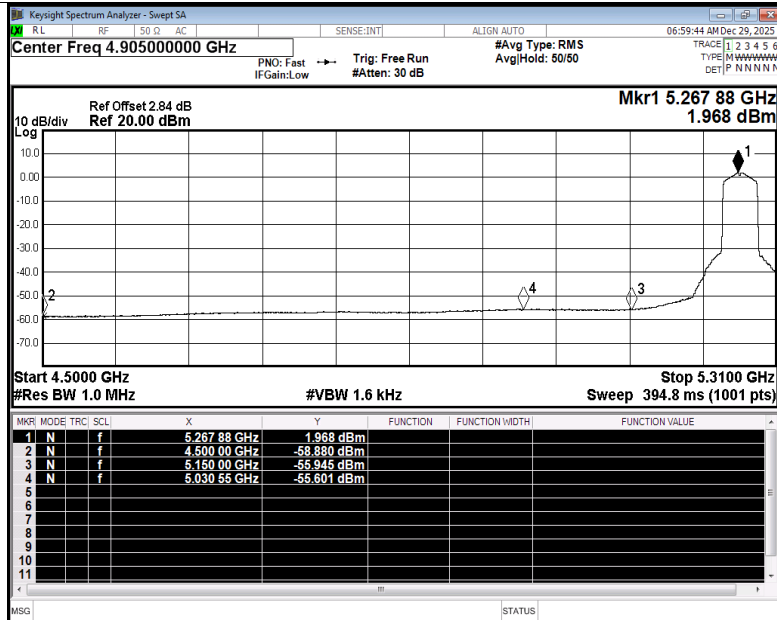

Restrict Band NVNT ac40 5270MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

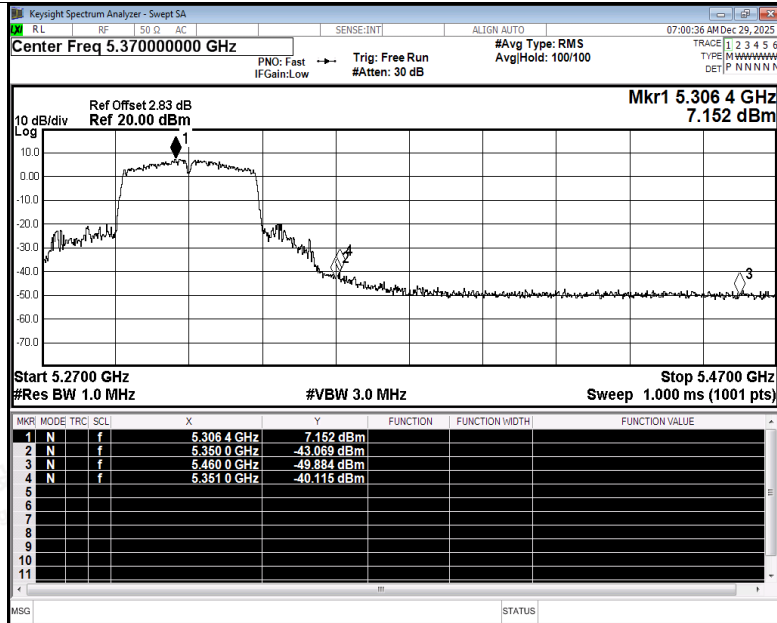

Restrict Band NVNT ac40 5310MHz Ant3 Peak

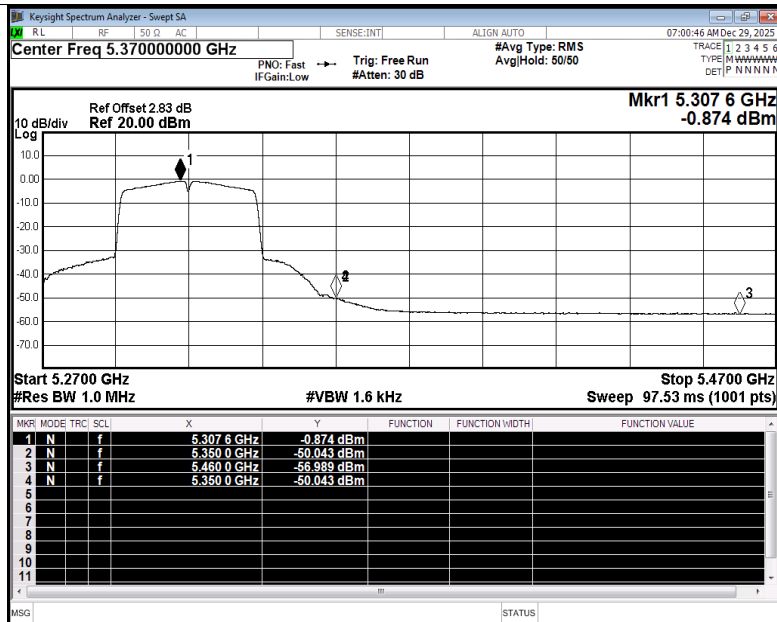

Restrict Band NVNT ac40 5310MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

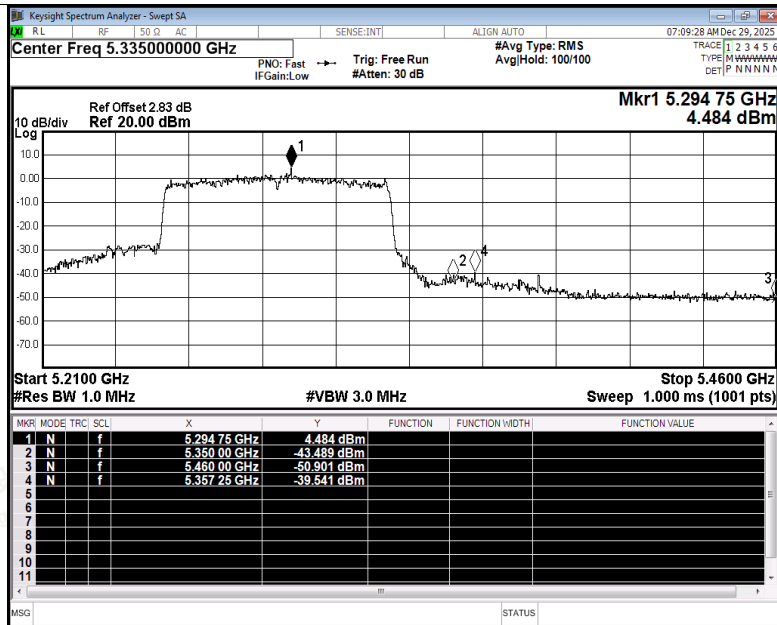

Restrict Band NVNT ac80 5290MHz Ant3 Peak

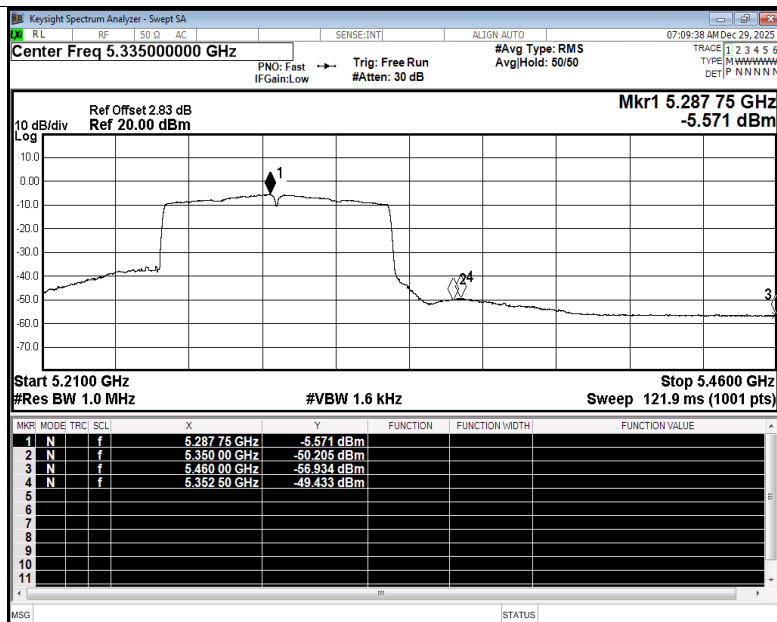

Restrict Band NVNT ac80 5290MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

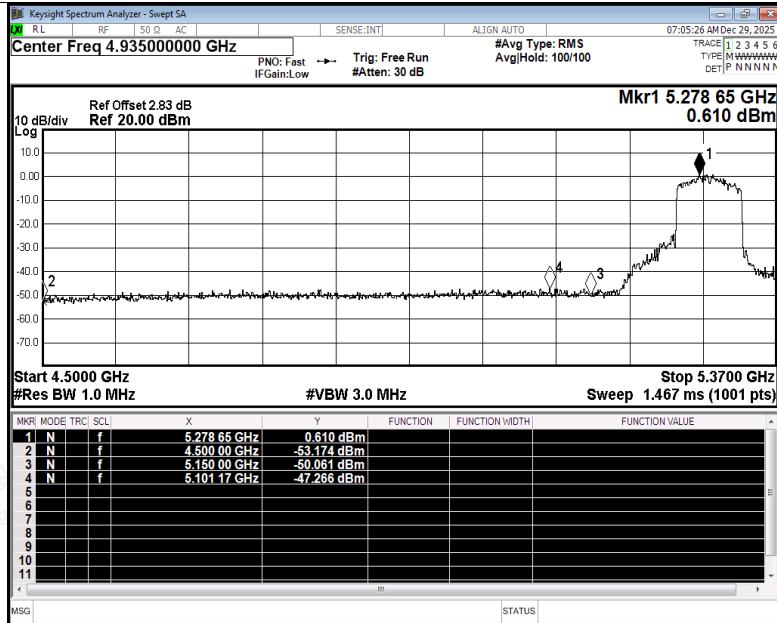

Restrict Band NVNT ac80 5290MHz Ant3 Peak

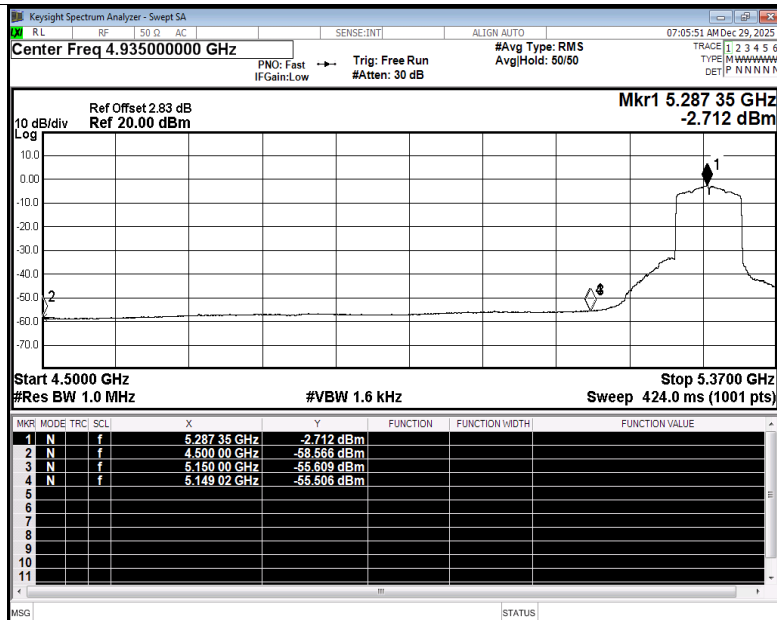

Restrict Band NVNT ac80 5290MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

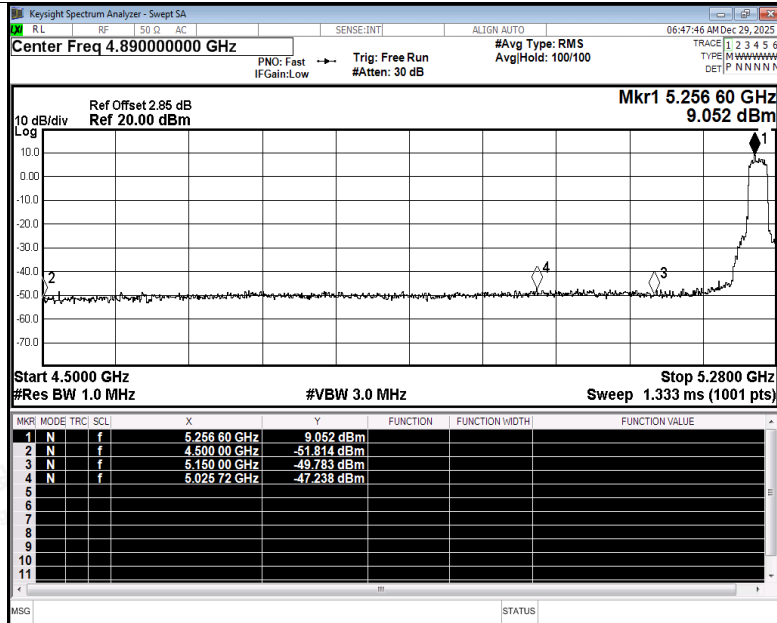

Restrict Band NVNT ax20 5260MHz Ant3 Peak

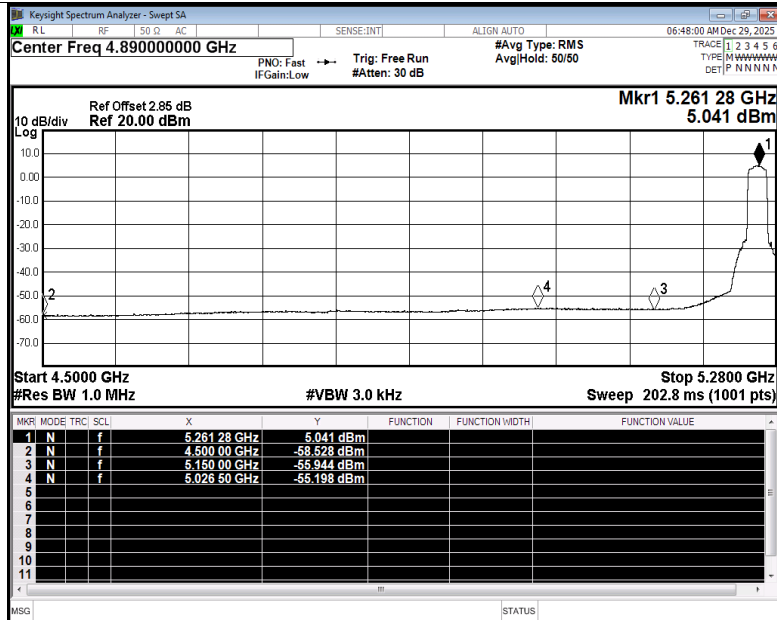

Restrict Band NVNT ax20 5260MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

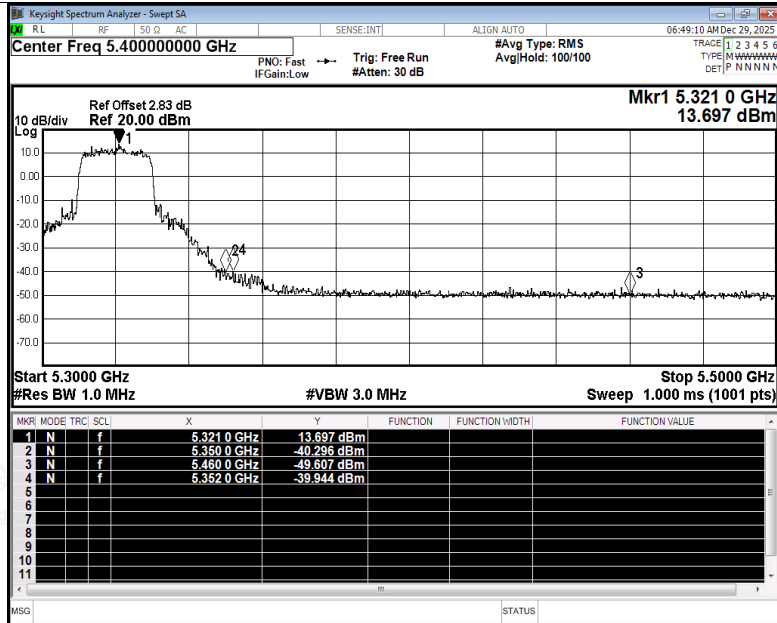

Restrict Band NVNT ax20 5320MHz Ant3 Peak

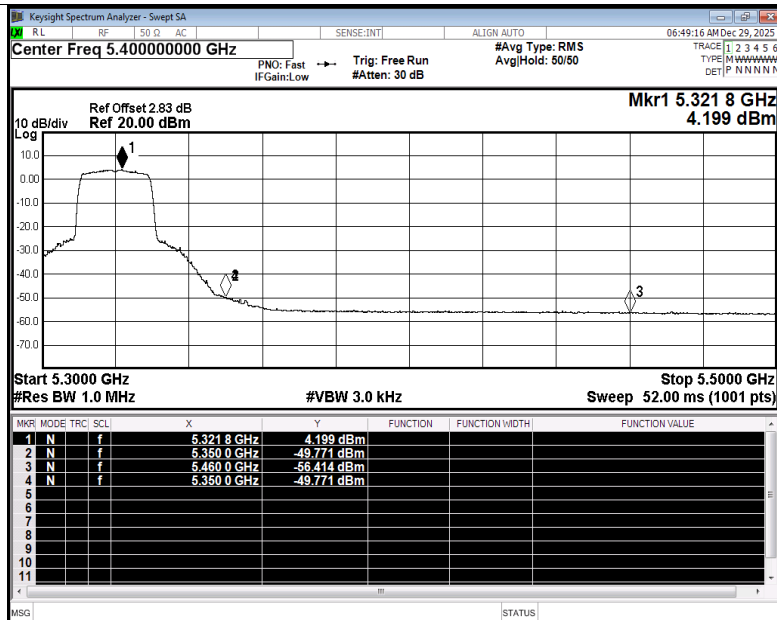

Restrict Band NVNT ax20 5320MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

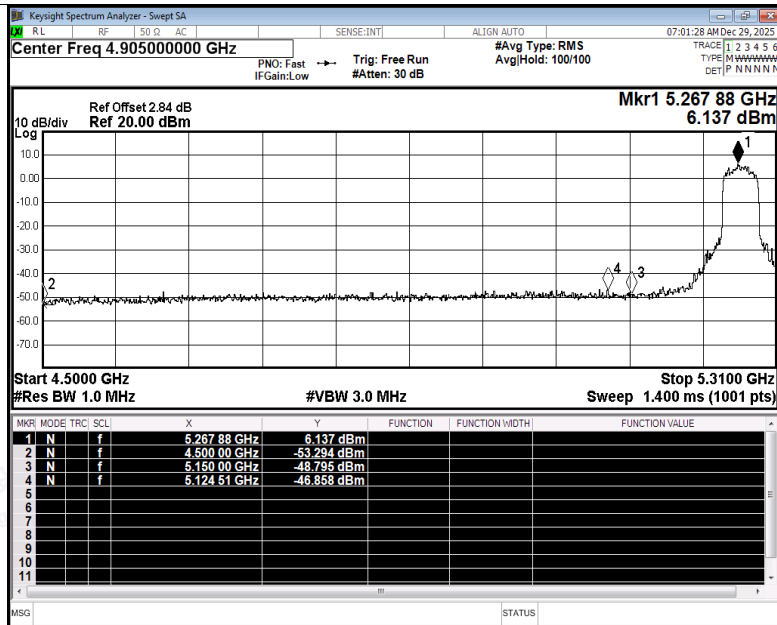

Restrict Band NVNT ax40 5270MHz Ant3 Peak

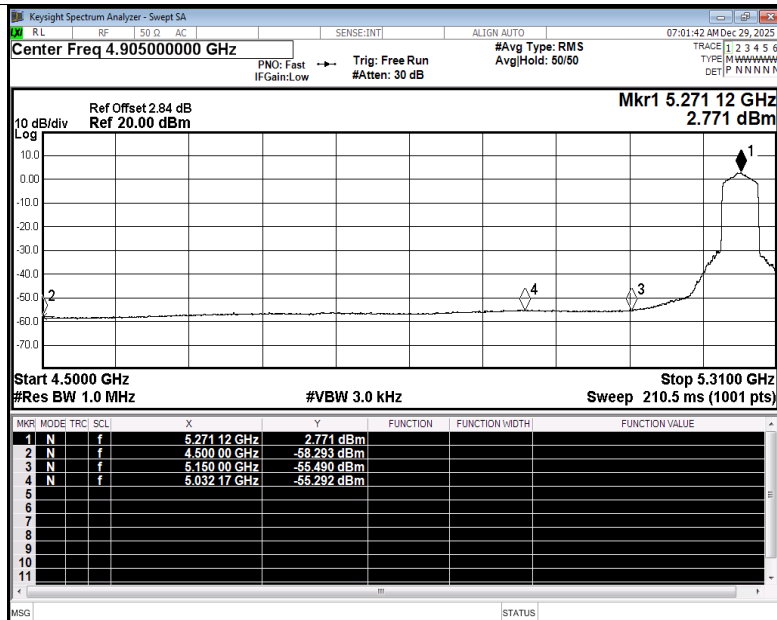

Restrict Band NVNT ax40 5270MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

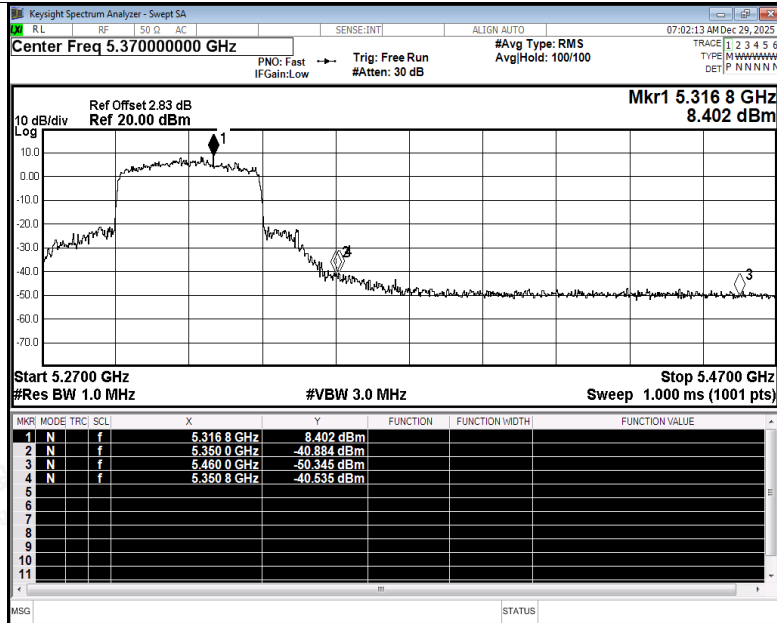

Restrict Band NVNT ax40 5310MHz Ant3 Peak

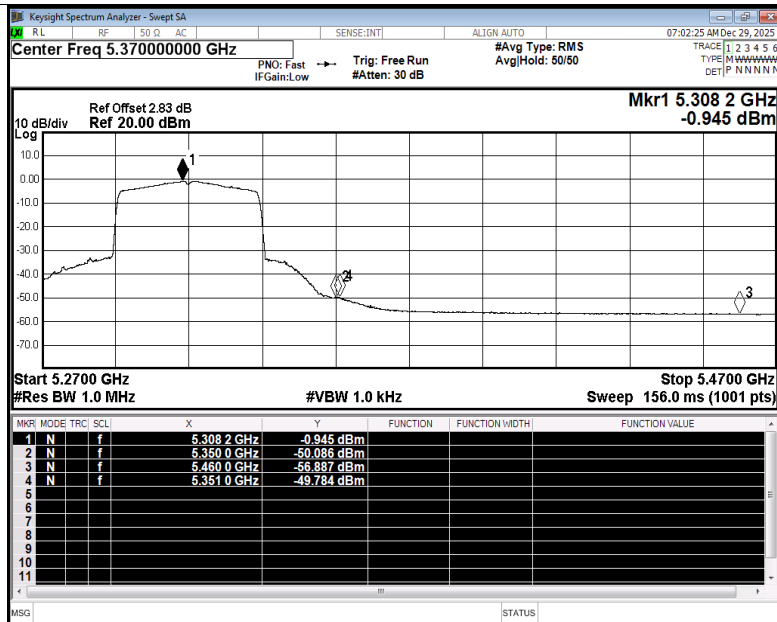

Restrict Band NVNT ax40 5310MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

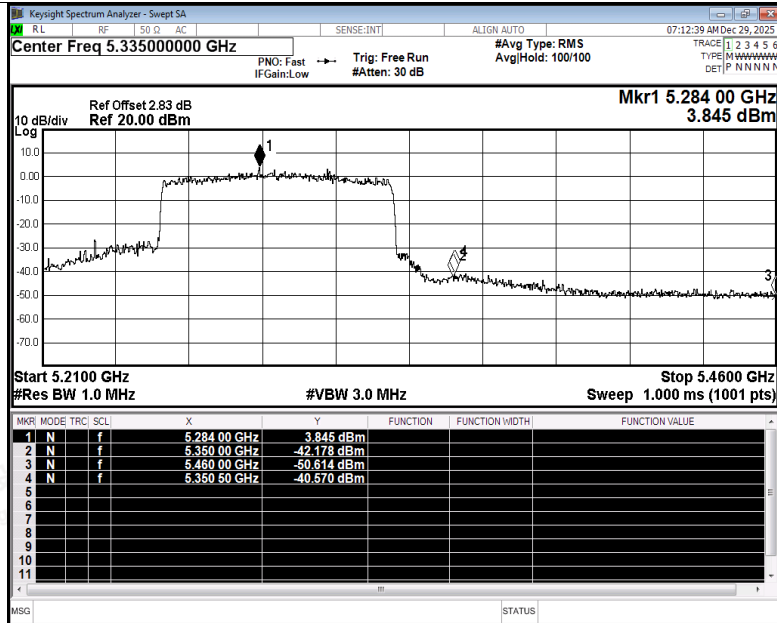

Restrict Band NVNT ax80 5290MHz Ant3 Peak

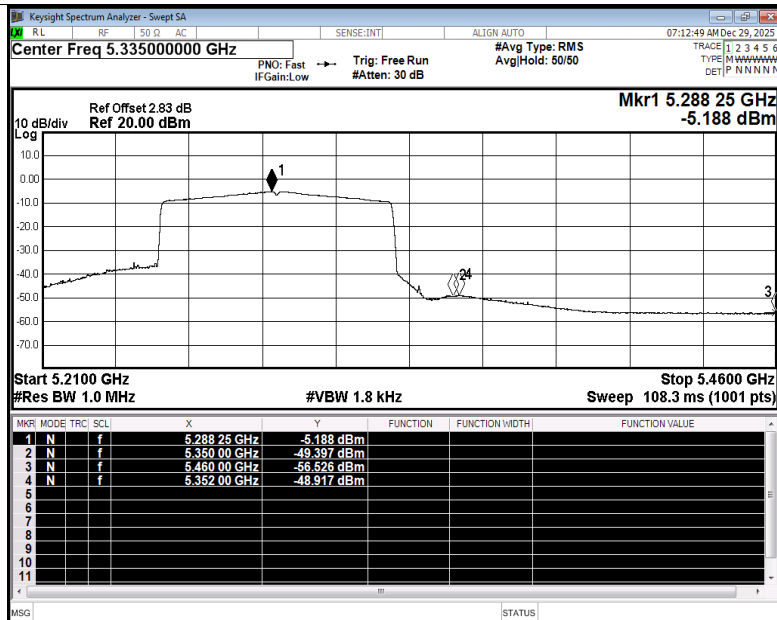

Restrict Band NVNT ax80 5290MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

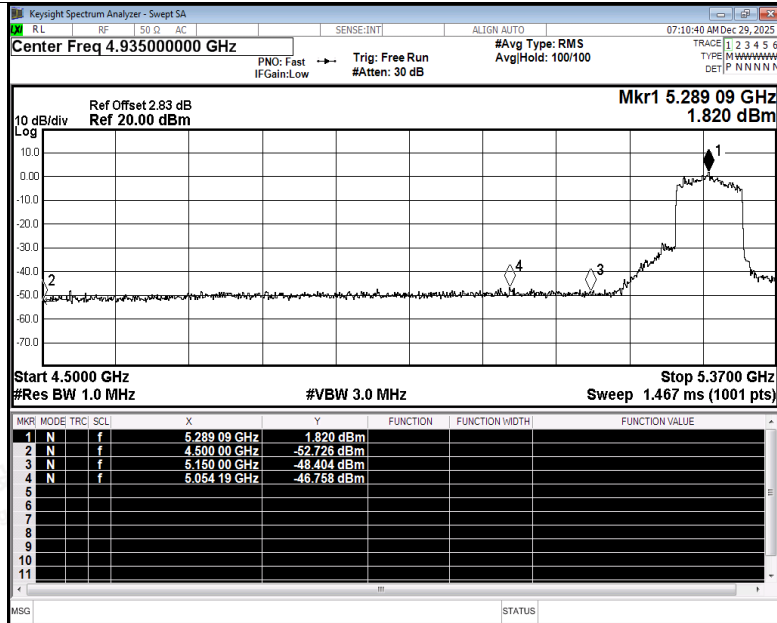

Restrict Band NVNT ax80 5290MHz Ant3 Peak

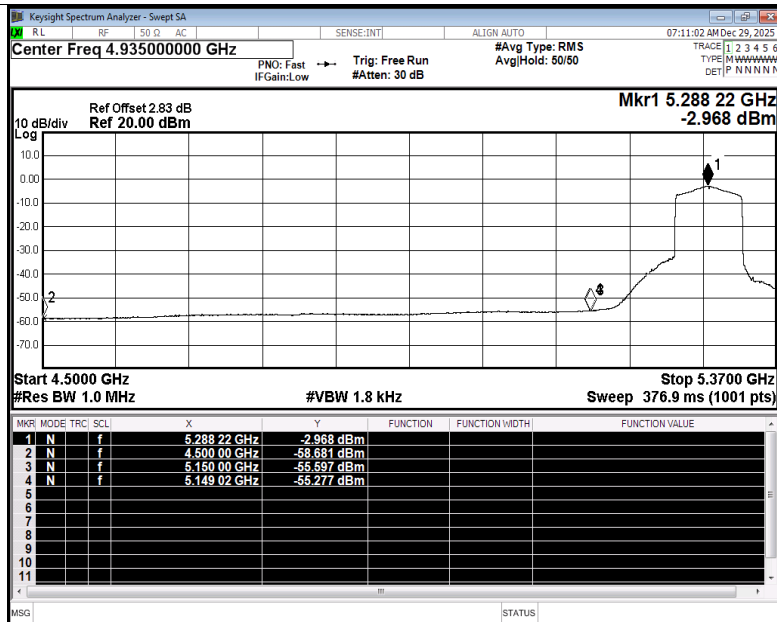

Restrict Band NVNT ax80 5290MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

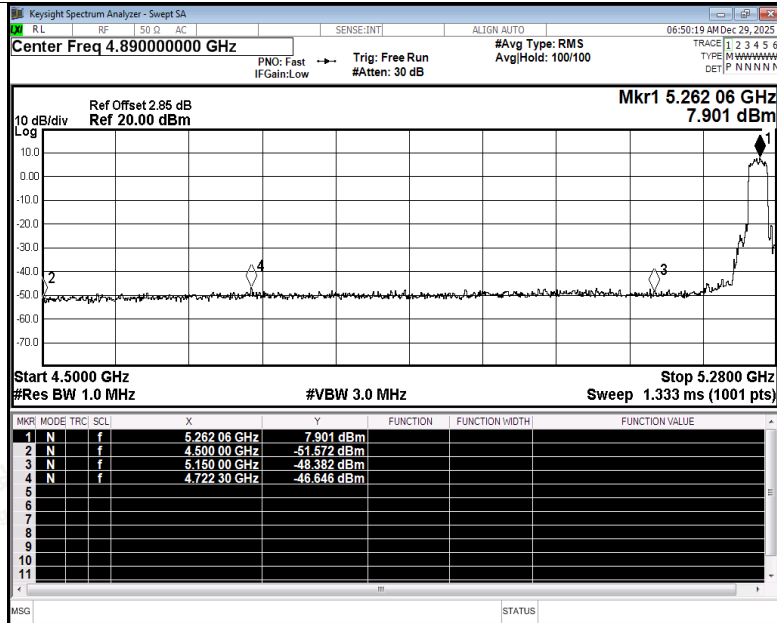

Restrict Band NVNT be20 5260MHz Ant3 Peak

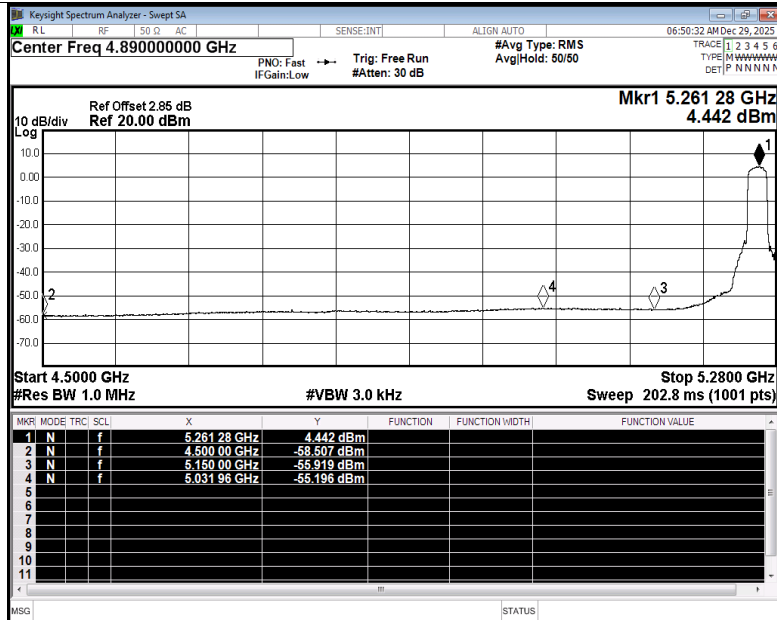

Restrict Band NVNT be20 5260MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

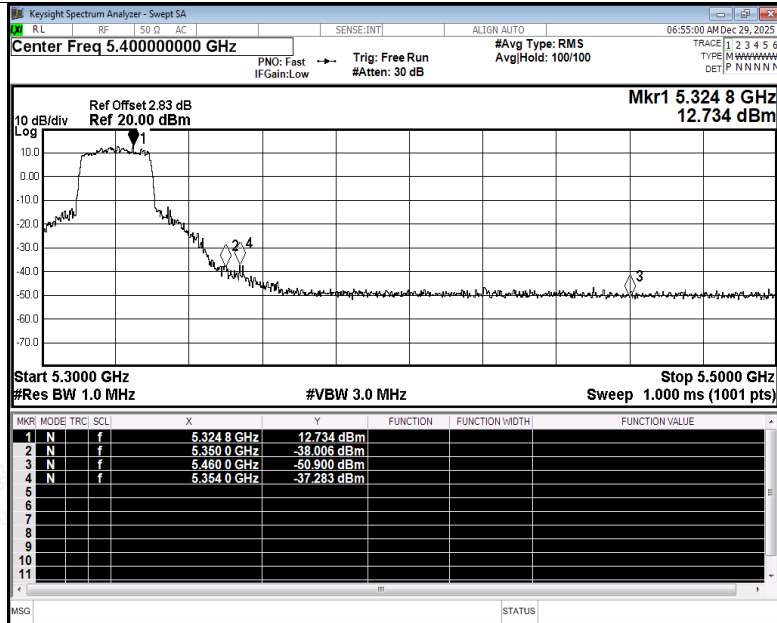

Restrict Band NVNT be20 5320MHz Ant3 Peak

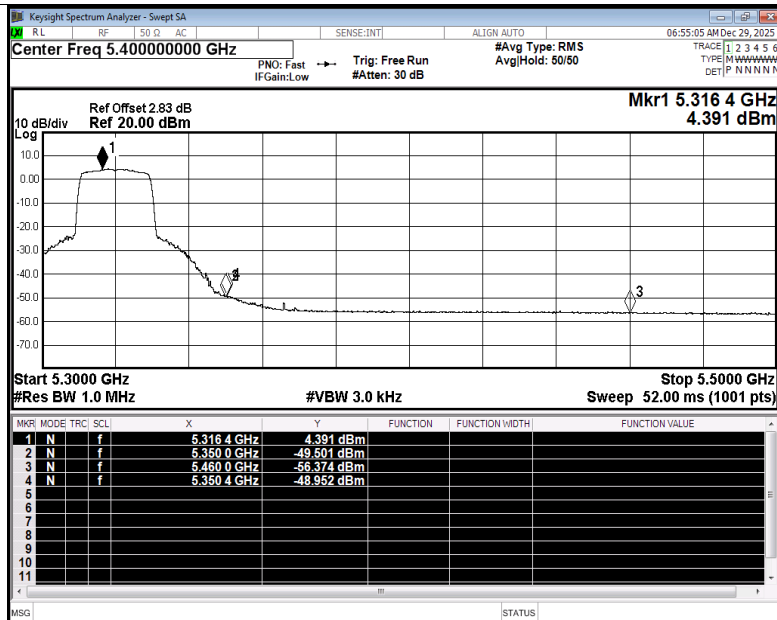

Restrict Band NVNT be20 5320MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

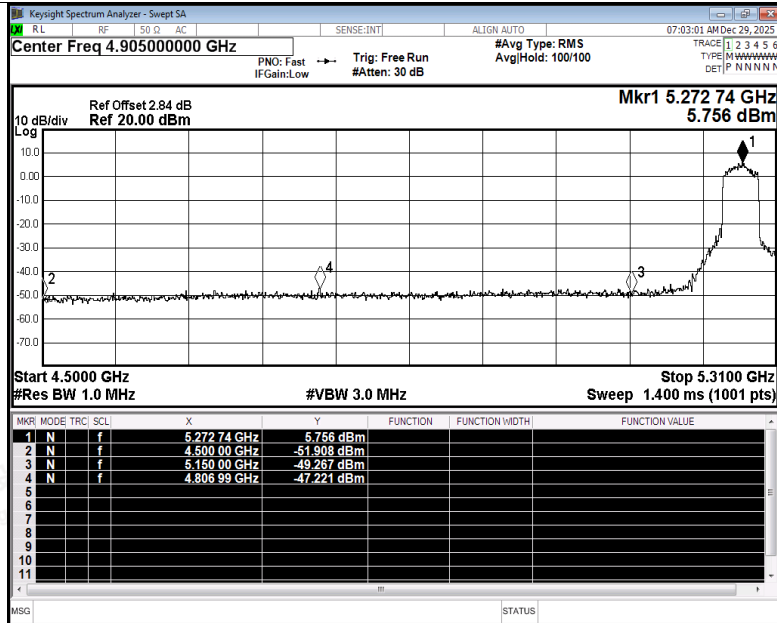

Restrict Band NVNT be40 5270MHz Ant3 Peak

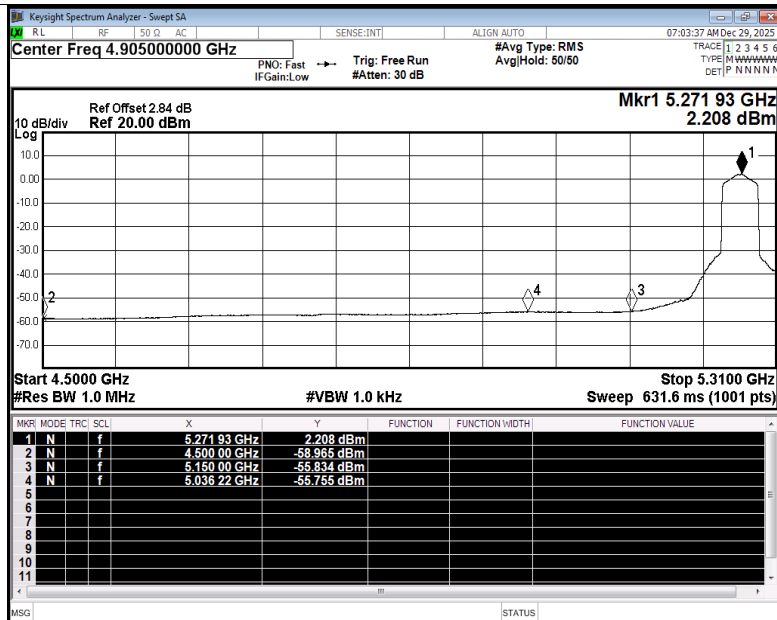

Restrict Band NVNT be40 5270MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

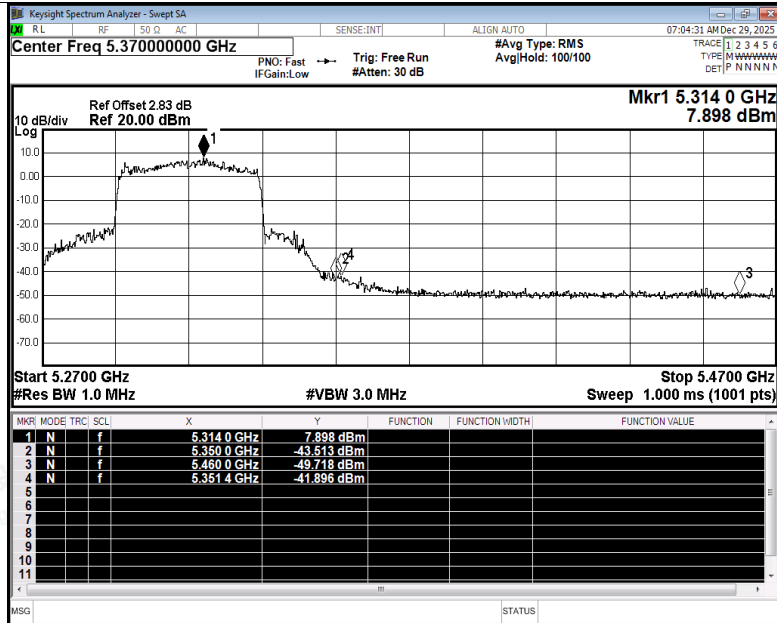

Restrict Band NVNT be40 5310MHz Ant3 Peak

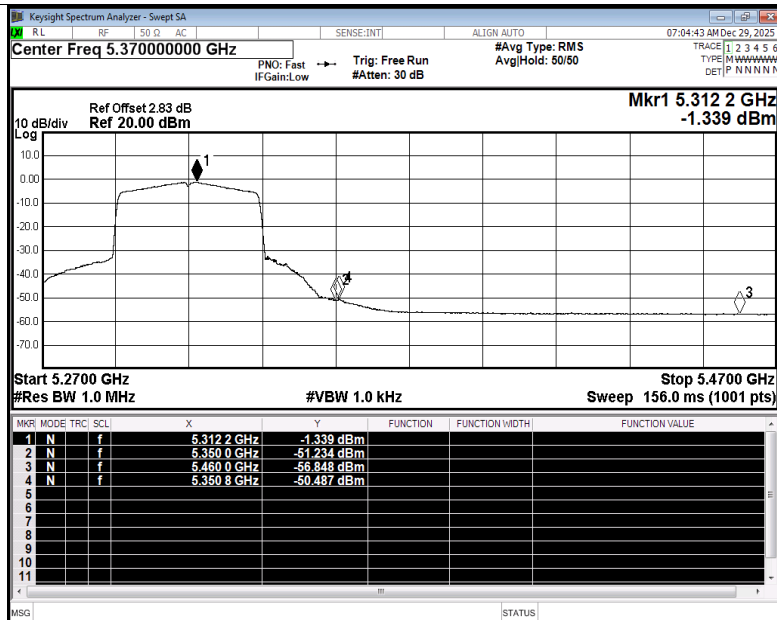

Restrict Band NVNT be40 5310MHz Ant3 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity