



Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/500KHz)	Duty Factor (dB)	Total PSD (dBm/500KHz)	Limit(dBm/500KHz)	Verdict
NVNT	a	5745	Ant4	-1.9	0.15	-1.75	29.44	Pass
NVNT	a	5785	Ant4	-1.08	0.15	-0.93	29.44	Pass
NVNT	a	5825	Ant4	-0.46	0.15	-0.31	29.44	Pass
NVNT	n20	5745	Ant4	-3.63	0.17	-3.46	29.44	Pass
NVNT	n20	5785	Ant4	-2.76	0.2	-2.56	29.44	Pass
NVNT	n20	5825	Ant4	-2.43	0.16	-2.27	29.44	Pass
NVNT	n40	5755	Ant4	-6.02	0.33	-5.69	29.44	Pass
NVNT	n40	5795	Ant4	-5.22	0.39	-4.83	29.44	Pass
NVNT	ac20	5745	Ant4	-3.48	0.65	-2.83	29.44	Pass
NVNT	ac20	5785	Ant4	-2.79	0.55	-2.24	29.44	Pass
NVNT	ac20	5825	Ant4	-2.19	0.55	-1.64	29.44	Pass
NVNT	ac40	5755	Ant4	-6.38	1.14	-5.24	29.44	Pass
NVNT	ac40	5795	Ant4	-5.57	1.09	-4.48	29.44	Pass
NVNT	ac80	5775	Ant4	-9.13	1.76	-7.37	29.44	Pass
NVNT	ax20	5745	Ant4	-3.64	0.58	-3.06	29.44	Pass
NVNT	ax20	5785	Ant4	-2.92	0.69	-2.23	29.44	Pass
NVNT	ax20	5825	Ant4	-2.41	0.58	-1.83	29.44	Pass
NVNT	ax40	5755	Ant4	-6.05	0.69	-5.36	29.44	Pass
NVNT	ax40	5795	Ant4	-5.32	0.58	-4.74	29.44	Pass
NVNT	ax80	5775	Ant4	-8.44	0.6	-7.84	29.44	Pass
NVNT	be20	5745	Ant4	-3.89	0.58	-3.31	29.44	Pass
NVNT	be20	5785	Ant4	-2.69	0.69	-2	29.44	Pass
NVNT	be20	5825	Ant4	-2.23	0.69	-1.54	29.44	Pass
NVNT	be40	5755	Ant4	-6.03	0.67	-5.36	29.44	Pass
NVNT	be40	5795	Ant4	-5.37	0.67	-4.7	29.44	Pass
NVNT	be80	5775	Ant4	-8.55	0.69	-7.86	29.44	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/500KHz)	Duty Factor (dB)	Total PSD (dBm/500KHz)	Limit(dBm/500KHz)	Verdict
NVNT	a	5745	Ant5	-1.27	0.15	-1.12	29.33	Pass
NVNT	a	5785	Ant5	-0.7	0.15	-0.55	29.33	Pass
NVNT	a	5825	Ant5	1.03	0.18	1.21	29.33	Pass
NVNT	n20	5745	Ant5	-2.92	0.2	-2.72	29.33	Pass
NVNT	n20	5785	Ant5	-2.31	0.2	-2.11	29.33	Pass
NVNT	n20	5825	Ant5	-0.99	0.16	-0.83	29.33	Pass
NVNT	n40	5755	Ant5	-5.3	0.4	-4.9	29.33	Pass
NVNT	n40	5795	Ant5	-4.75	0.39	-4.36	29.33	Pass
NVNT	ac20	5745	Ant5	-3.21	0.54	-2.67	29.33	Pass
NVNT	ac20	5785	Ant5	-2.39	0.54	-1.85	29.33	Pass
NVNT	ac20	5825	Ant5	-0.97	0.55	-0.41	29.33	Pass
NVNT	ac40	5755	Ant5	-5.34	1.14	-4.2	29.33	Pass
NVNT	ac40	5795	Ant5	-4.97	1.3	-3.67	29.33	Pass
NVNT	ac80	5775	Ant5	-8.18	1.76	-6.42	29.33	Pass
NVNT	ax20	5745	Ant5	-2.9	0.71	-2.19	29.33	Pass
NVNT	ax20	5785	Ant5	-2.4	0.58	-1.82	29.33	Pass
NVNT	ax20	5825	Ant5	-1.12	0.58	-0.54	29.33	Pass
NVNT	ax40	5755	Ant5	-4.86	0.58	-4.28	29.33	Pass
NVNT	ax40	5795	Ant5	-4.7	0.58	-4.12	29.33	Pass
NVNT	ax80	5775	Ant5	-7.68	0.6	-7.08	29.33	Pass
NVNT	be20	5745	Ant5	-3.07	0.56	-2.51	29.33	Pass
NVNT	be20	5785	Ant5	-2.14	0.56	-1.58	29.33	Pass
NVNT	be20	5825	Ant5	-1.08	0.56	-0.52	29.33	Pass
NVNT	be40	5755	Ant5	-4.78	0.56	-4.22	29.33	Pass
NVNT	be40	5795	Ant5	-4.76	0.56	-4.2	29.33	Pass
NVNT	be80	5775	Ant5	-7.42	0.69	-6.73	29.33	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Total PSD (dBm/500KHz)						Limit (dBm/500KHz)	Verdict
			Ant1	Ant2	Ant3	Ant4	Ant5	Ant1+Ant2+Ant3+Ant4+Ant5		
NVNT	n20	5745	-1.31	-2.63	-2.53	-3.46	-2.72	4.52	22.34	Pass
NVNT	n20	5785	-0.74	-1.92	-1.56	-2.56	-2.11	5.26	22.34	Pass
NVNT	n20	5825	-0.72	-3.06	-2.31	-2.27	-0.83	5.25	22.34	Pass
NVNT	n40	5755	-3.61	-5.86	-4.73	-5.69	-4.9	2.11	22.34	Pass
NVNT	n40	5795	-3.14	-5.15	-4.18	-4.83	-4.36	2.71	22.34	Pass
NVNT	ac20	5745	-1.22	-3.36	-2.35	-2.83	-2.67	4.56	22.34	Pass
NVNT	ac20	5785	-0.71	-2.61	-1.04	-2.24	-1.85	5.36	22.34	Pass
NVNT	ac20	5825	-0.89	-2.52	-2.04	-1.64	-0.41	5.56	22.34	Pass
NVNT	ac40	5755	-3.4	-5.55	-4.23	-5.24	-4.2	2.54	22.34	Pass
NVNT	ac40	5795	-3.07	-4.9	-3.95	-4.48	-3.67	3.02	22.34	Pass
NVNT	ac80	5775	-5.82	-7.37	-6.29	-7.37	-6.42	0.38	22.34	Pass
NVNT	ax20	5745	-1.15	-3.14	-2.12	-3.06	-2.19	4.72	22.34	Pass
NVNT	ax20	5785	-0.55	-2.31	-1.43	-2.23	-1.82	5.37	22.34	Pass
NVNT	ax20	5825	-0.55	-2.78	-1.94	-1.83	-0.54	5.55	22.34	Pass
NVNT	ax40	5755	-3.61	-5.74	-4.19	-5.36	-4.28	2.42	22.34	Pass
NVNT	ax40	5795	-3.06	-4.94	-3.79	-4.74	-4.12	2.91	22.34	Pass
NVNT	ax80	5775	-6.03	-8.04	-6.76	-7.84	-7.08	-0.10	22.34	Pass
NVNT	be20	5745	-1.32	-3.31	-1.97	-3.31	-2.51	4.58	22.34	Pass
NVNT	be20	5785	-0.62	-2.53	-1.27	-2	-1.58	5.44	22.34	Pass
NVNT	be20	5825	-0.52	-2.65	-1.71	-1.54	-0.52	5.67	22.34	Pass
NVNT	be40	5755	-3.56	-5.77	-4.41	-5.36	-4.22	2.40	22.34	Pass
NVNT	be40	5795	-3.09	-5.16	-3.73	-4.7	-4.2	2.87	22.34	Pass
NVNT	be80	5775	-5.89	-7.69	-6.93	-7.86	-6.73	0.03	22.34	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

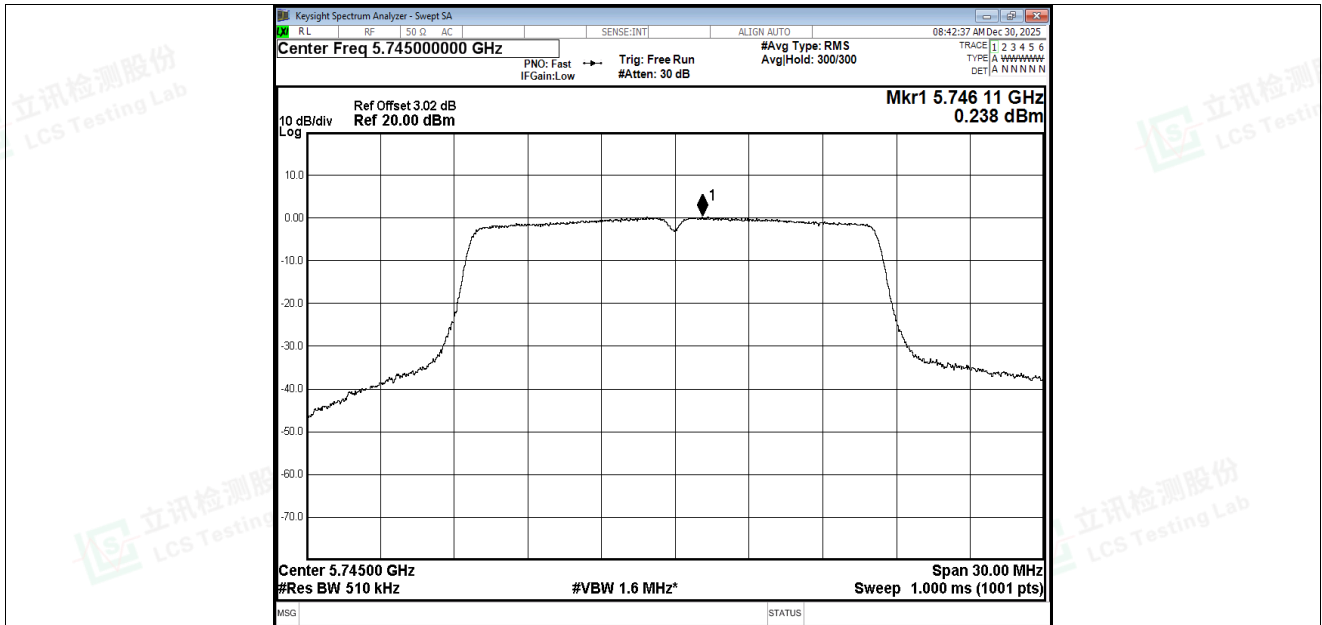

PSD NVNT a 5745MHz Ant1

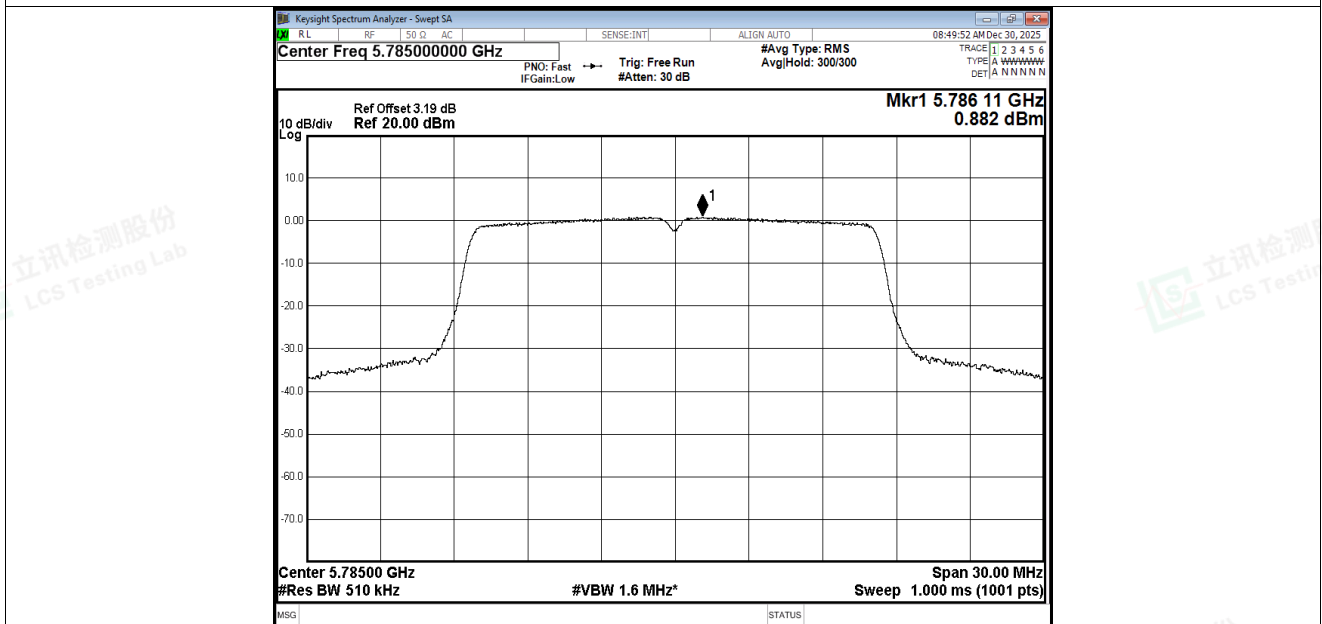

PSD NVNT a 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

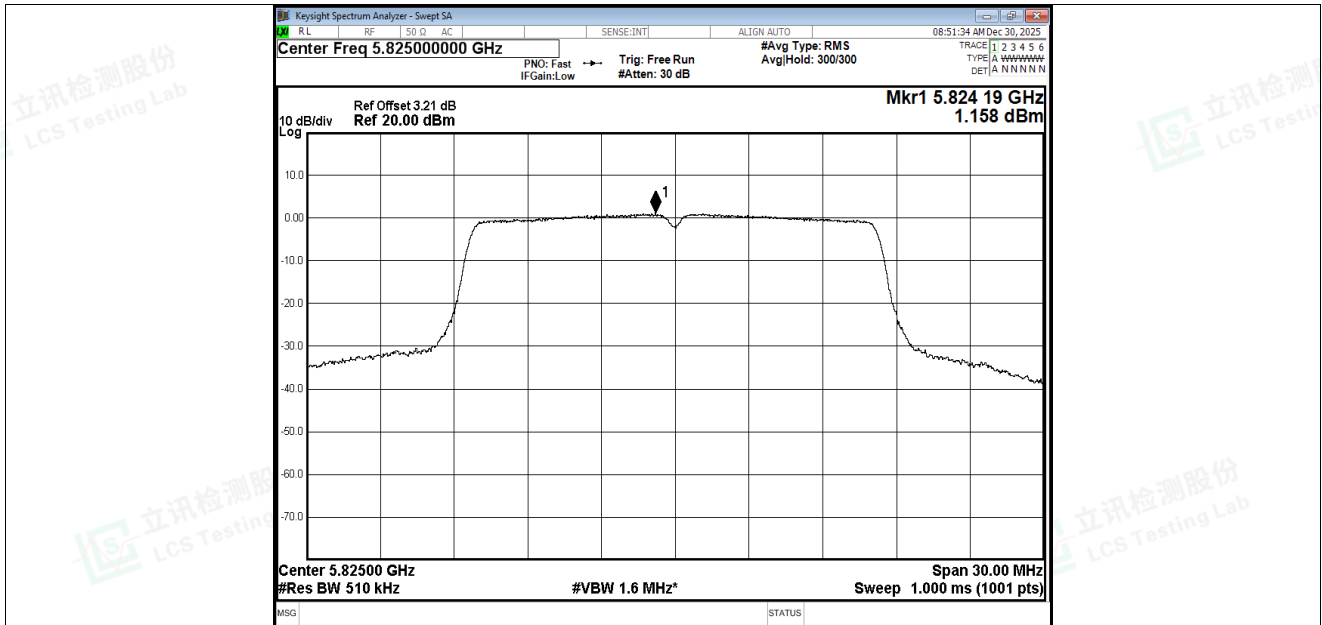

PSD NVNT a 5825MHz Ant1

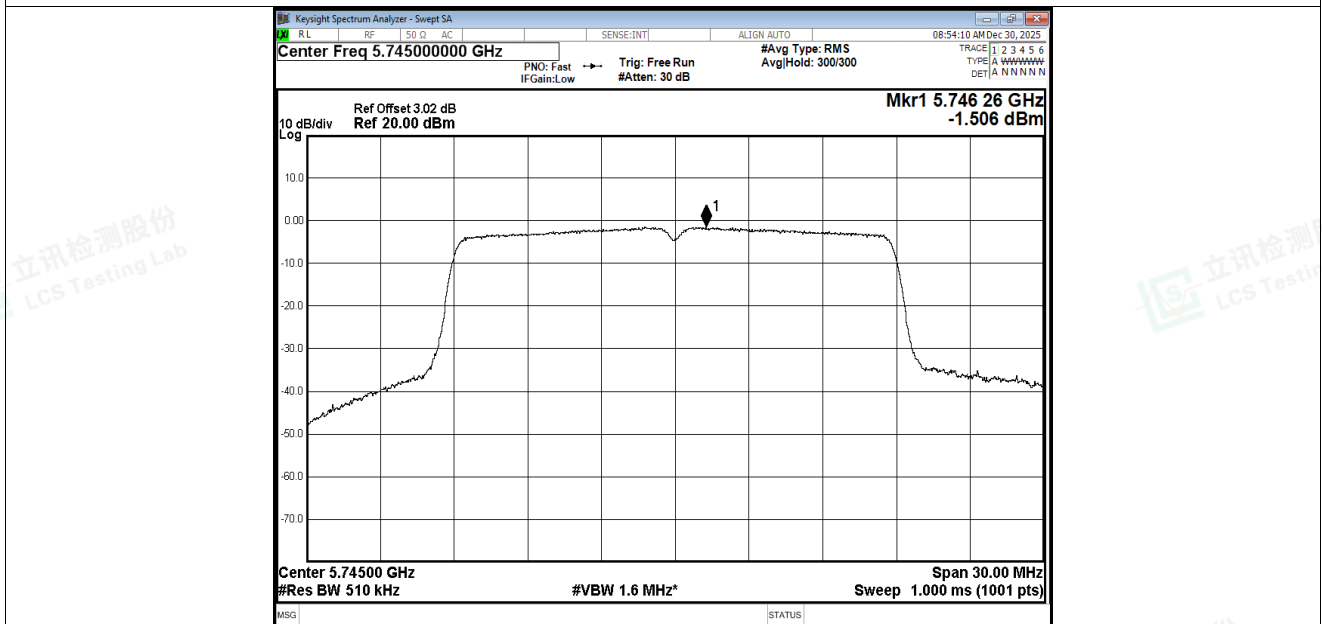

PSD NVNT n20 5745MHz Ant1





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

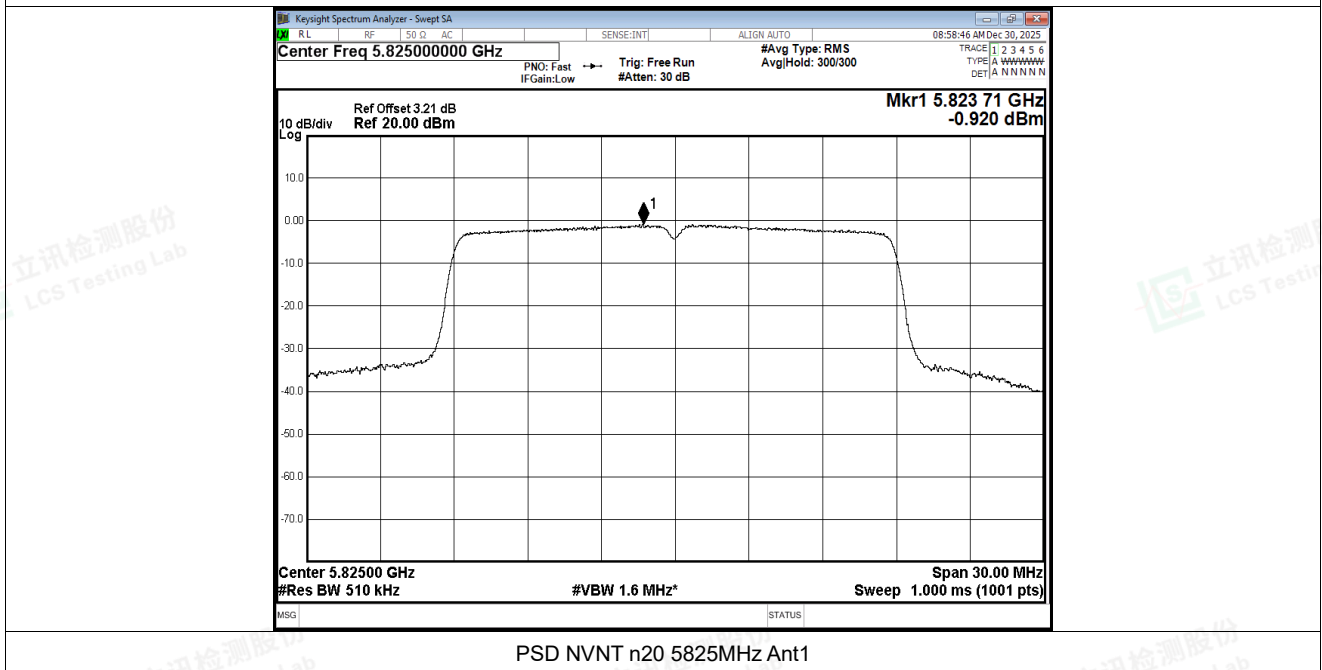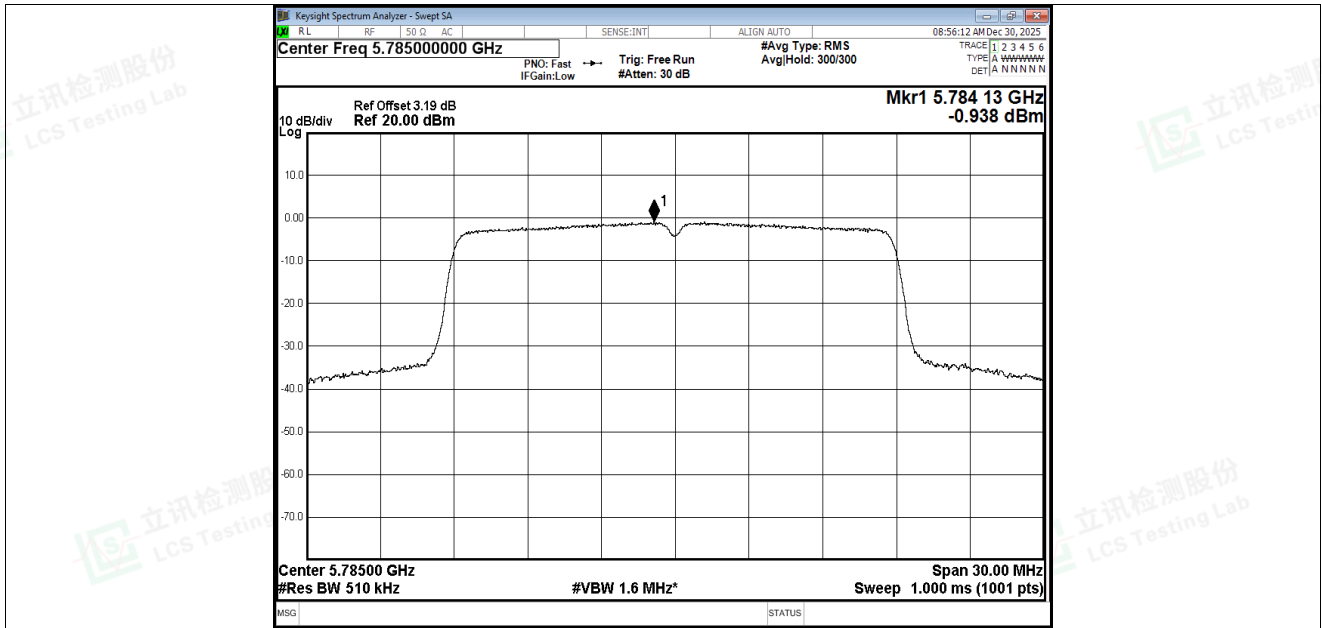


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

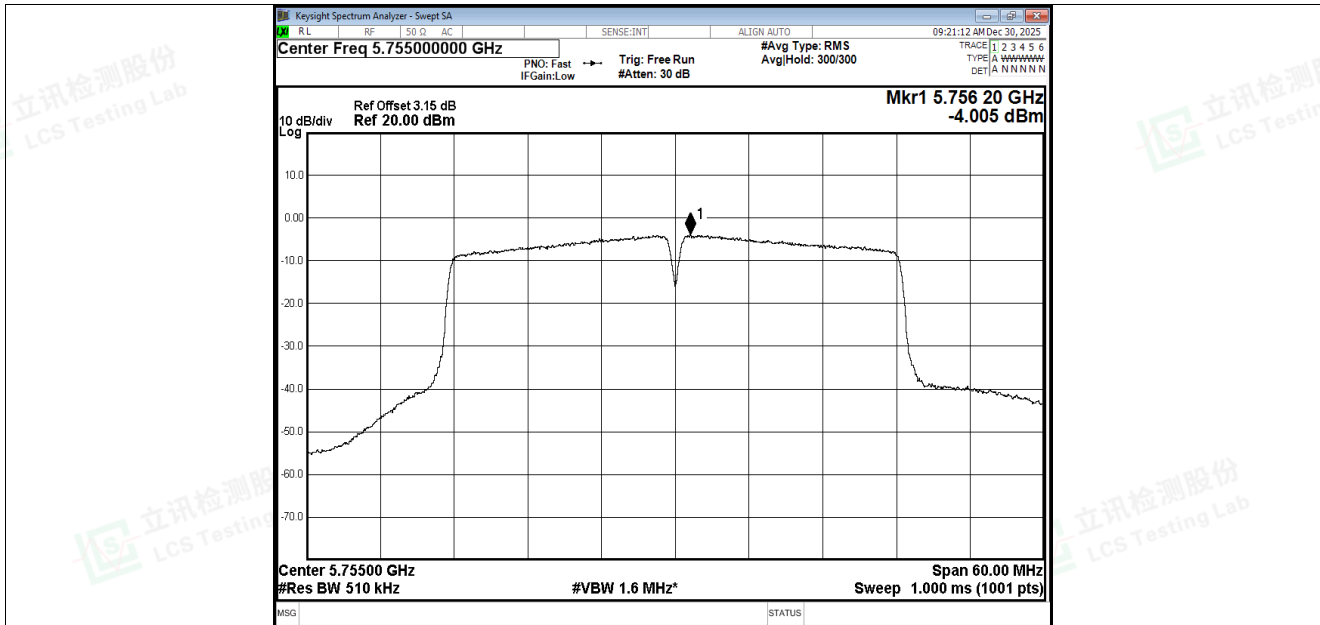

PSD NVNT n40 5755MHz Ant1

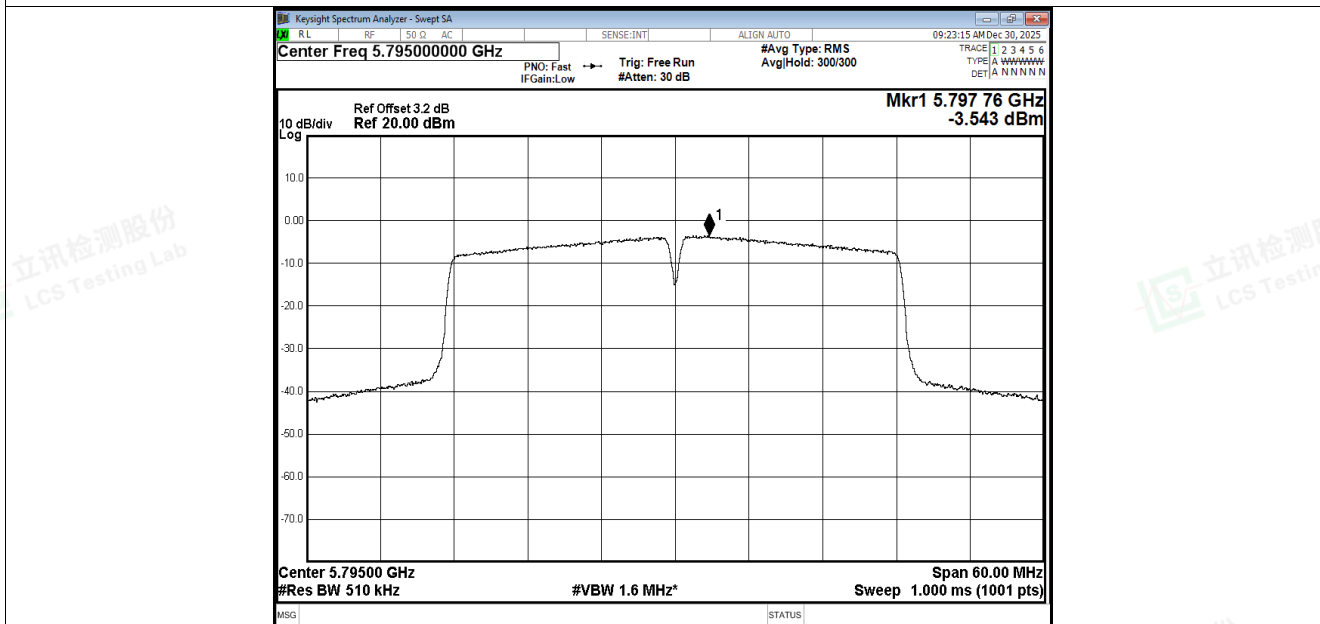

PSD NVNT n40 5795MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

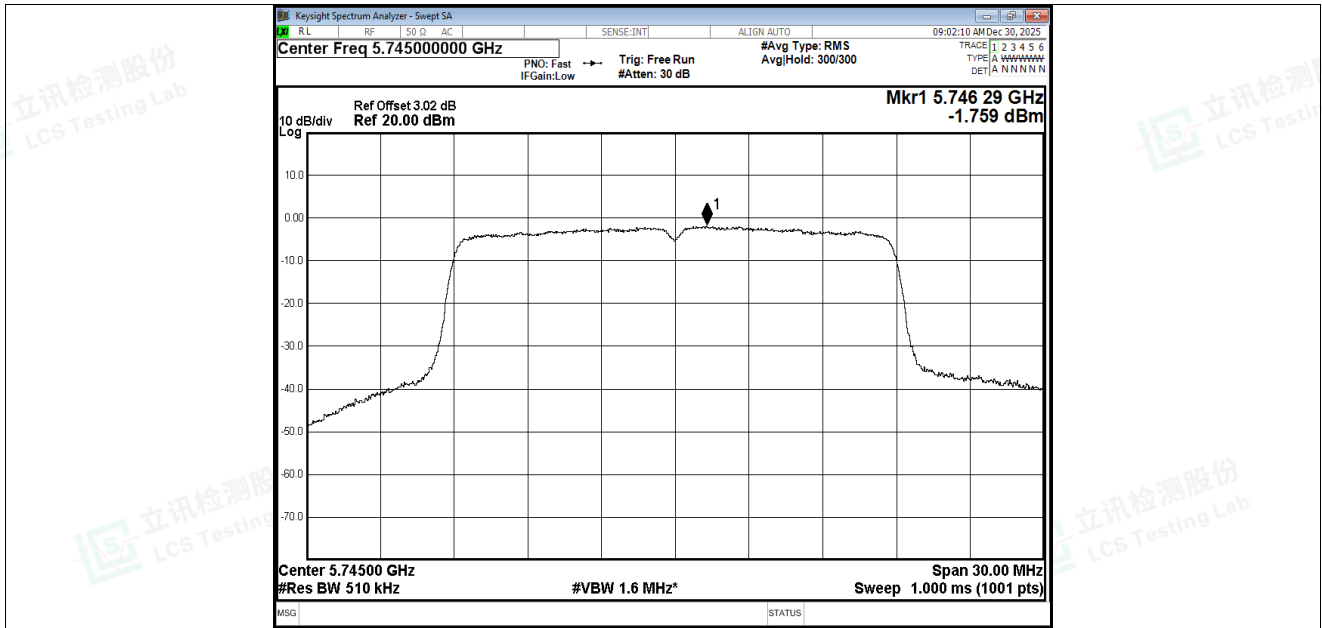

PSD NVNT ac20 5745MHz Ant1

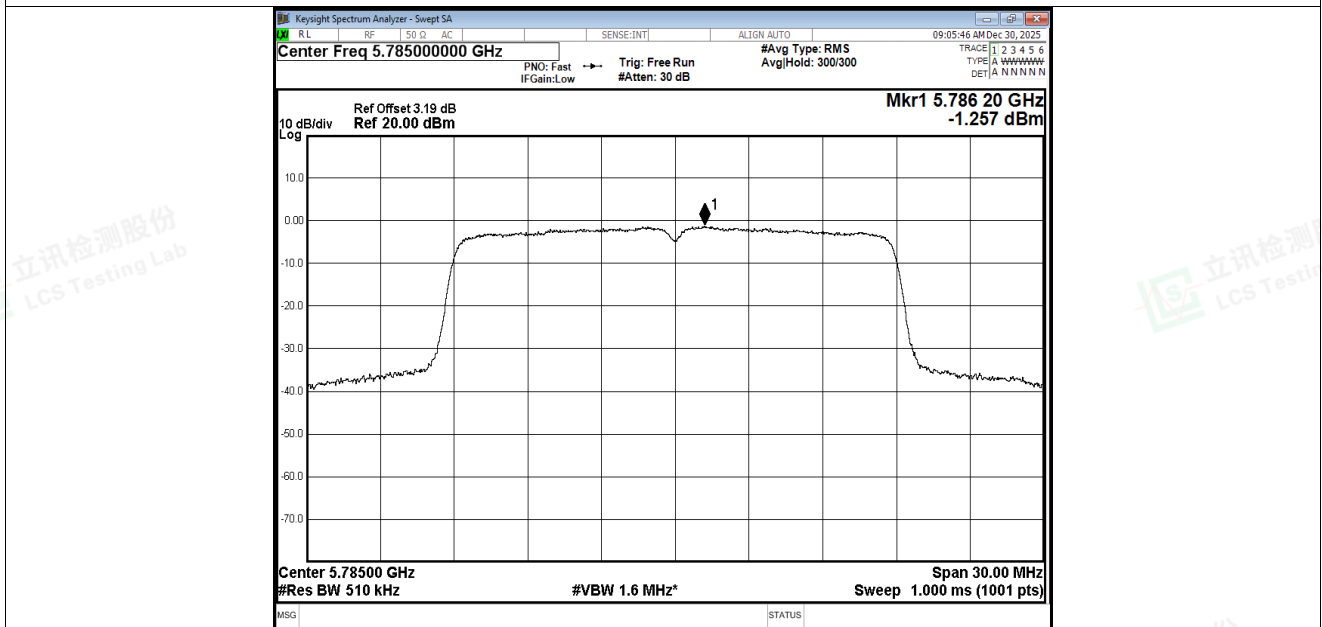

PSD NVNT ac20 5785MHz Ant1





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

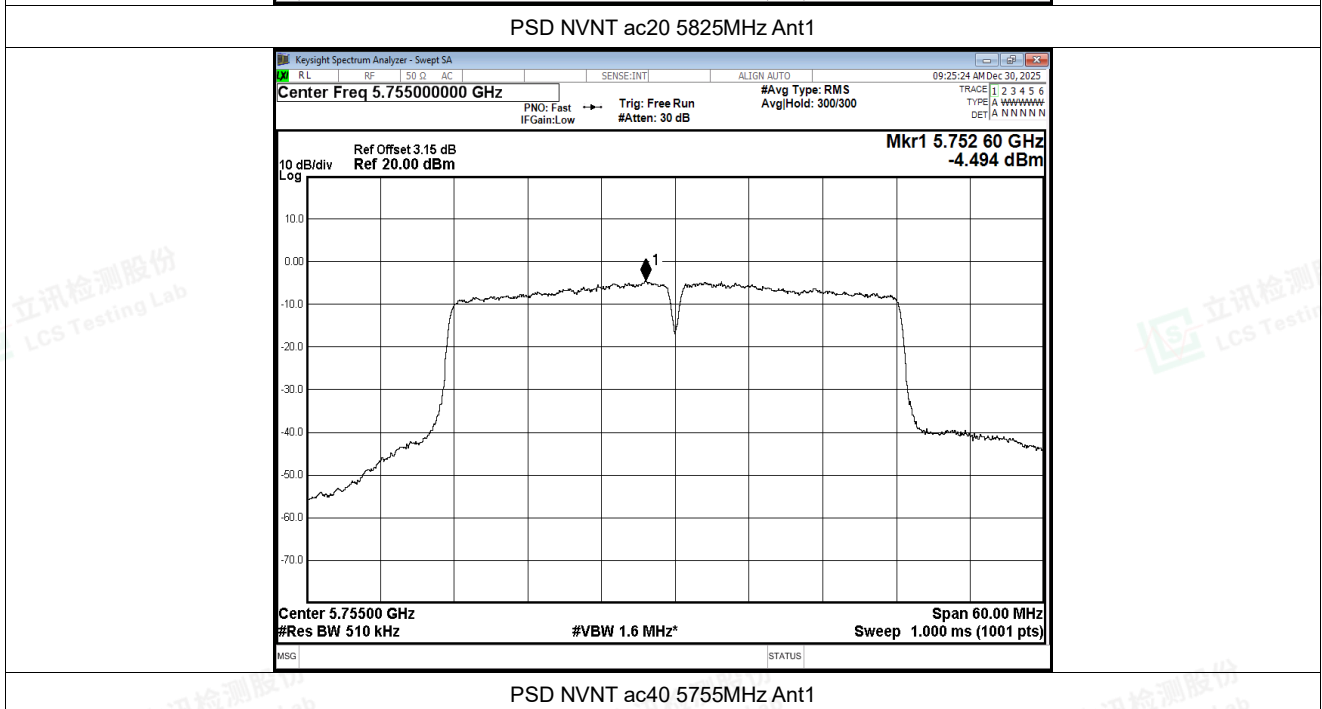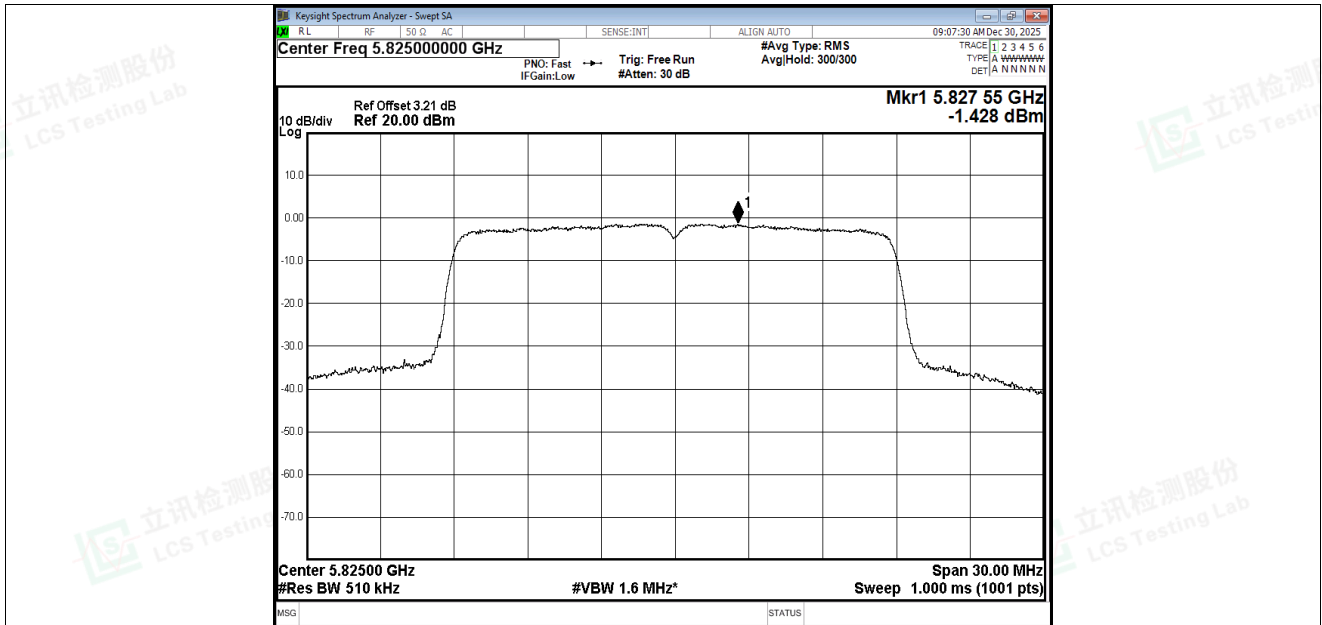


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

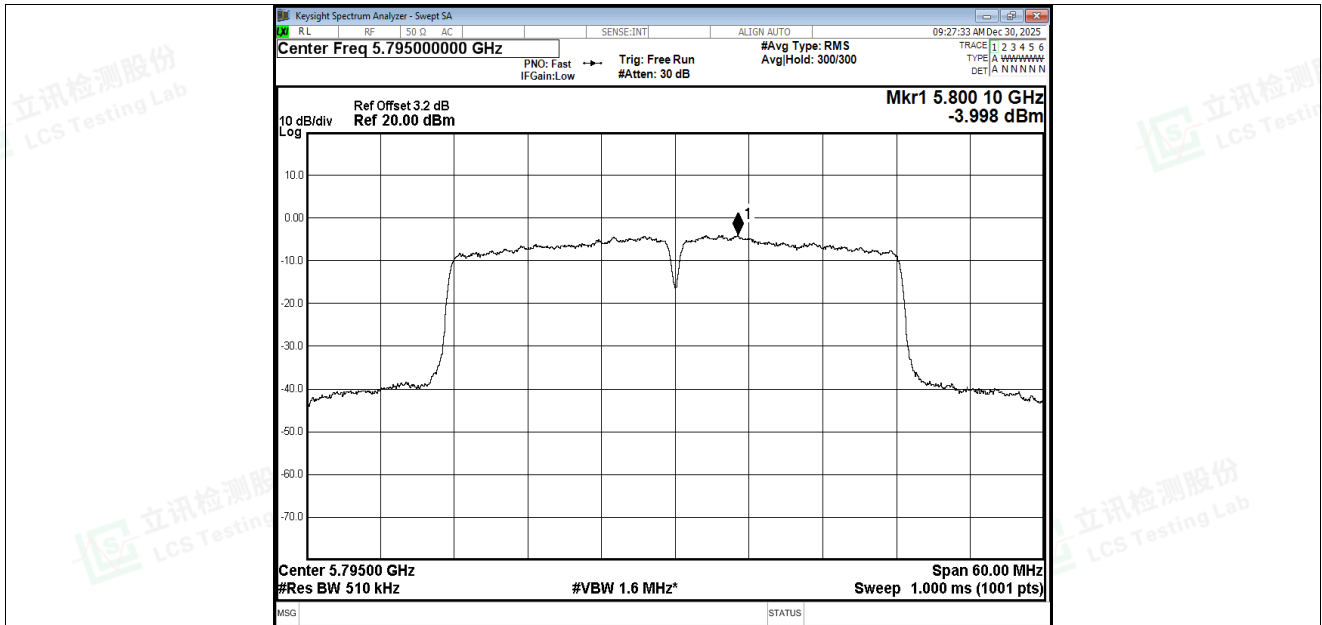

PSD NVNT ac40 5795MHz Ant1

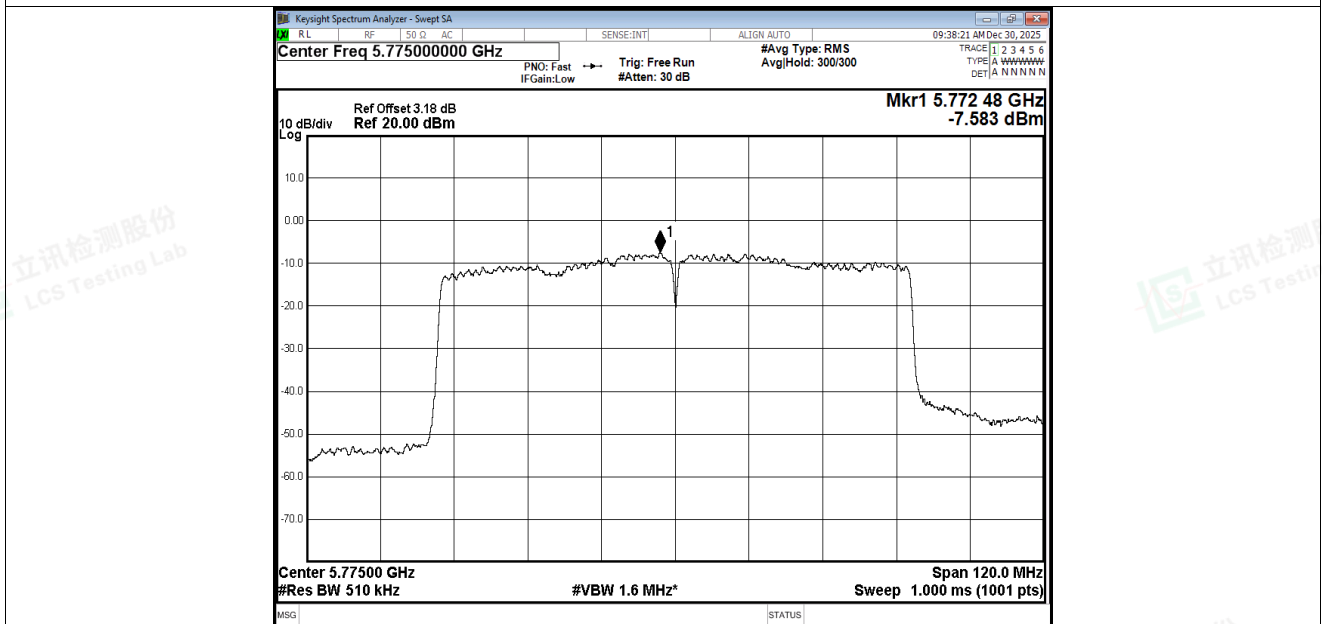

PSD NVNT ac80 5775MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

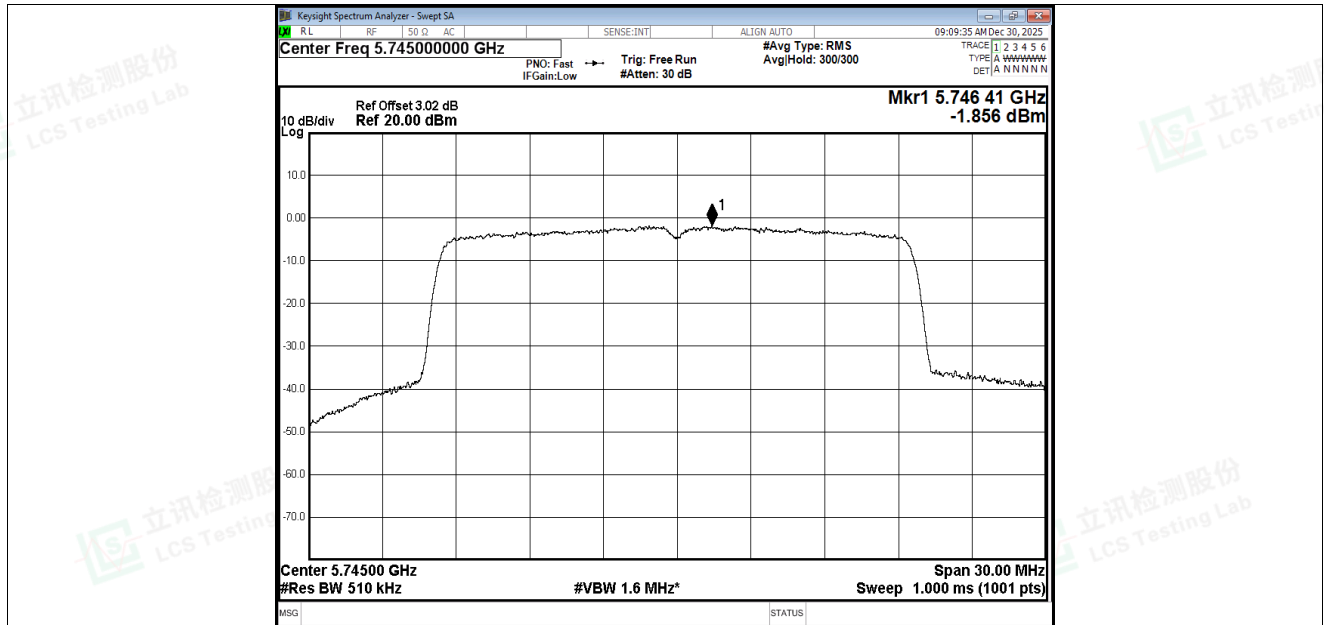

PSD NVNT ax20 5745MHz Ant1

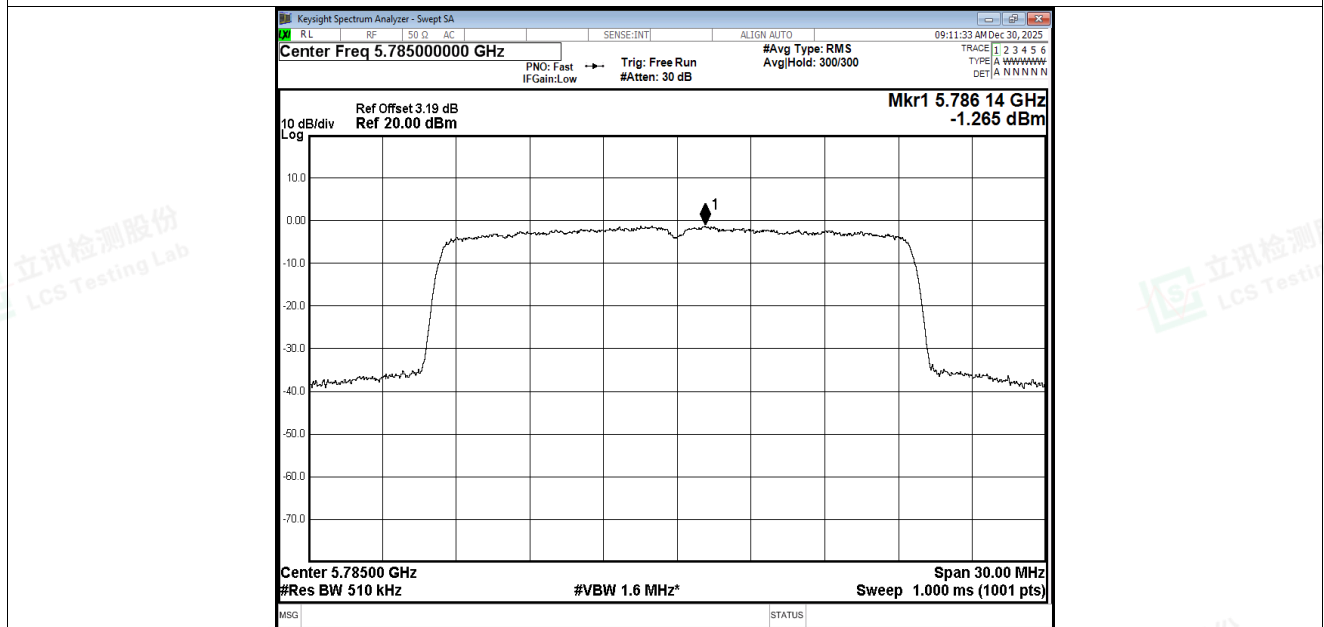

PSD NVNT ax20 5785MHz Ant1





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

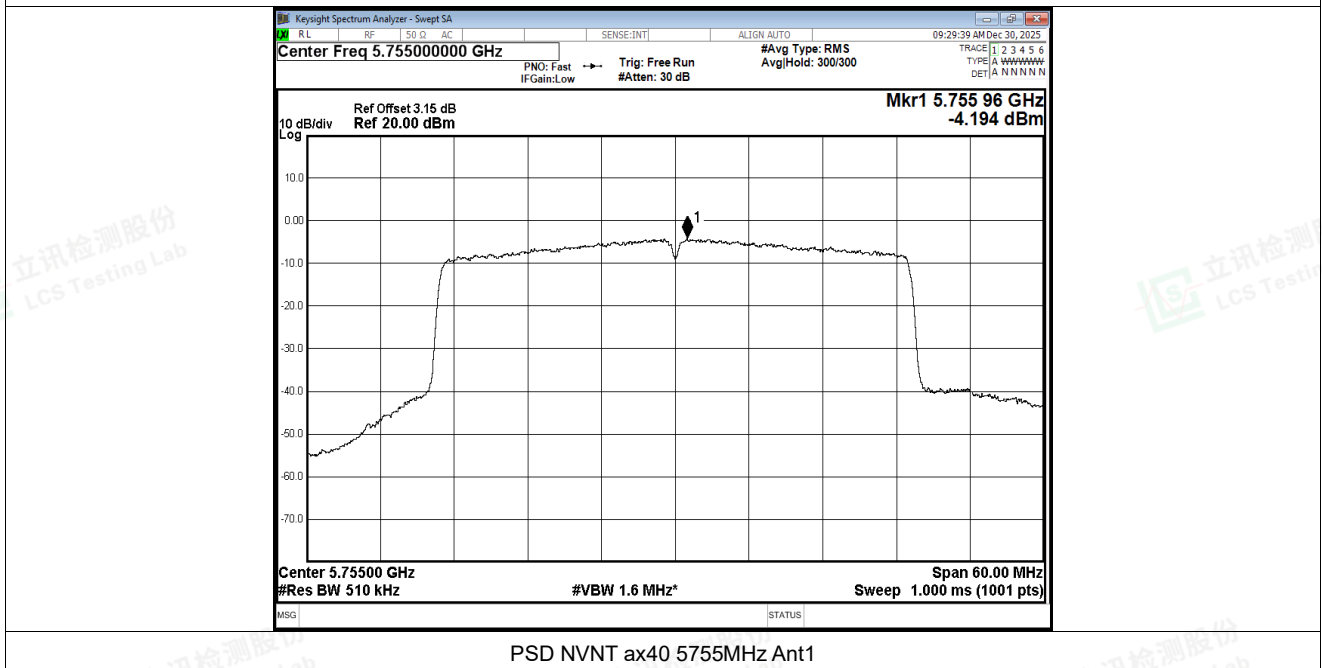
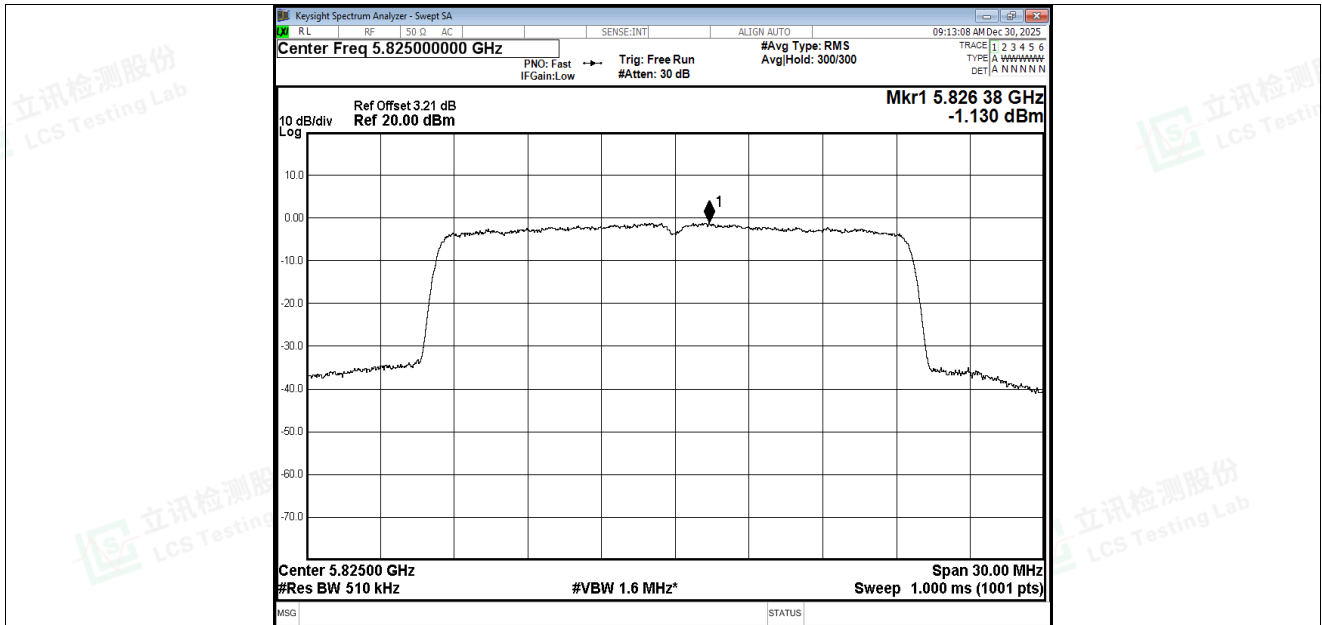


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

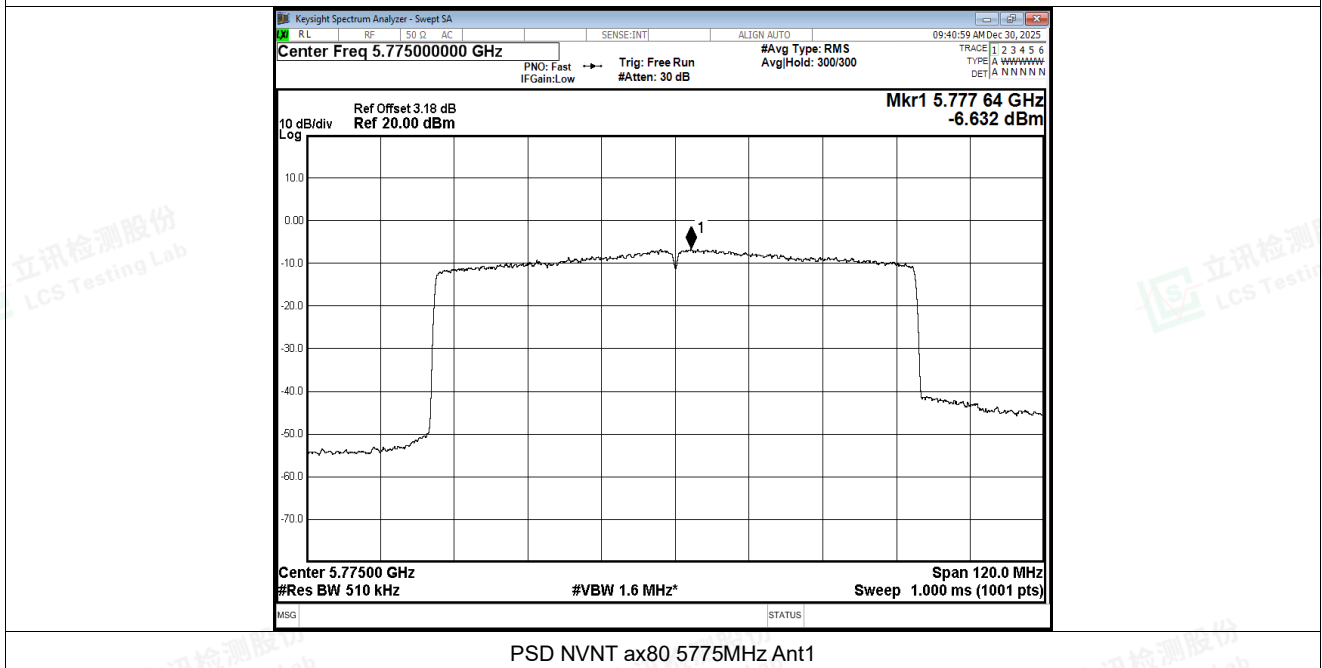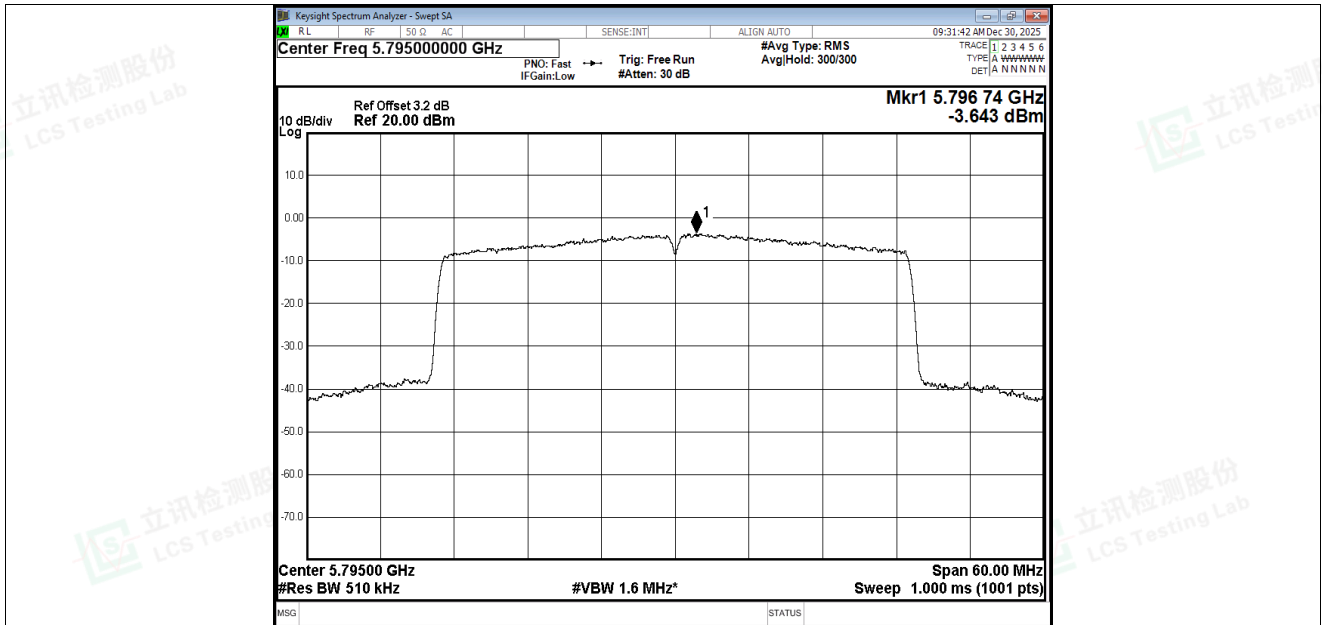


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

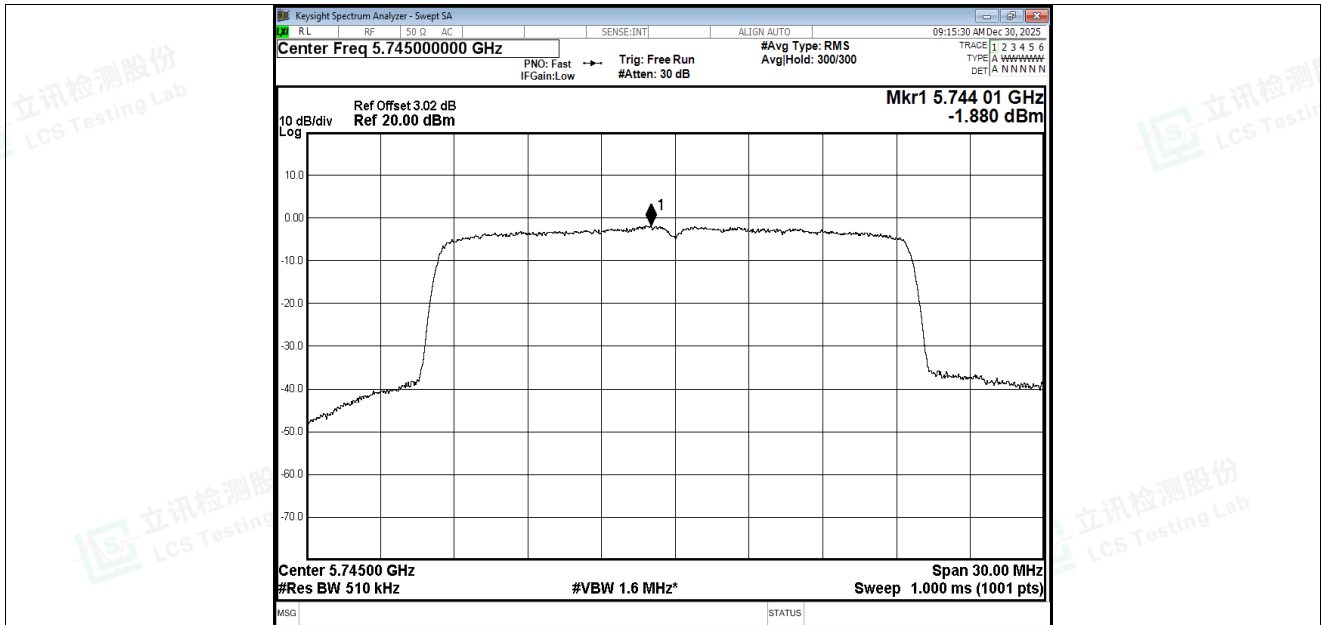

PSD NVNT be20 5745MHz Ant1

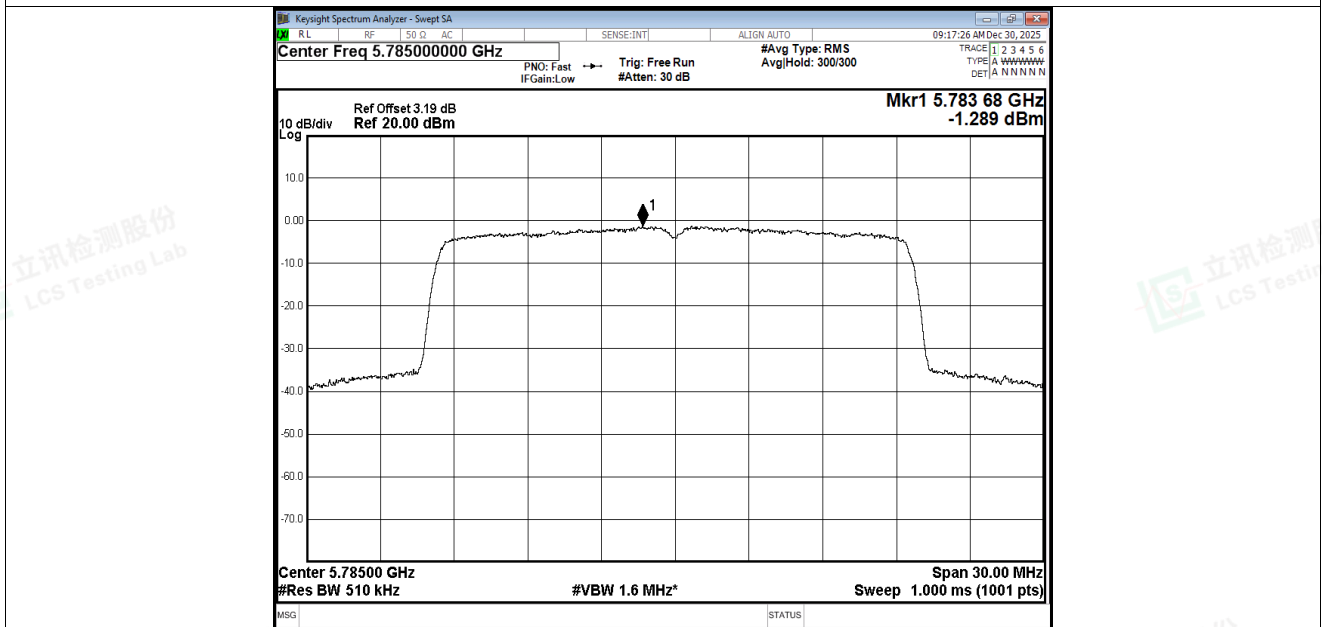

PSD NVNT be20 5785MHz Ant1





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

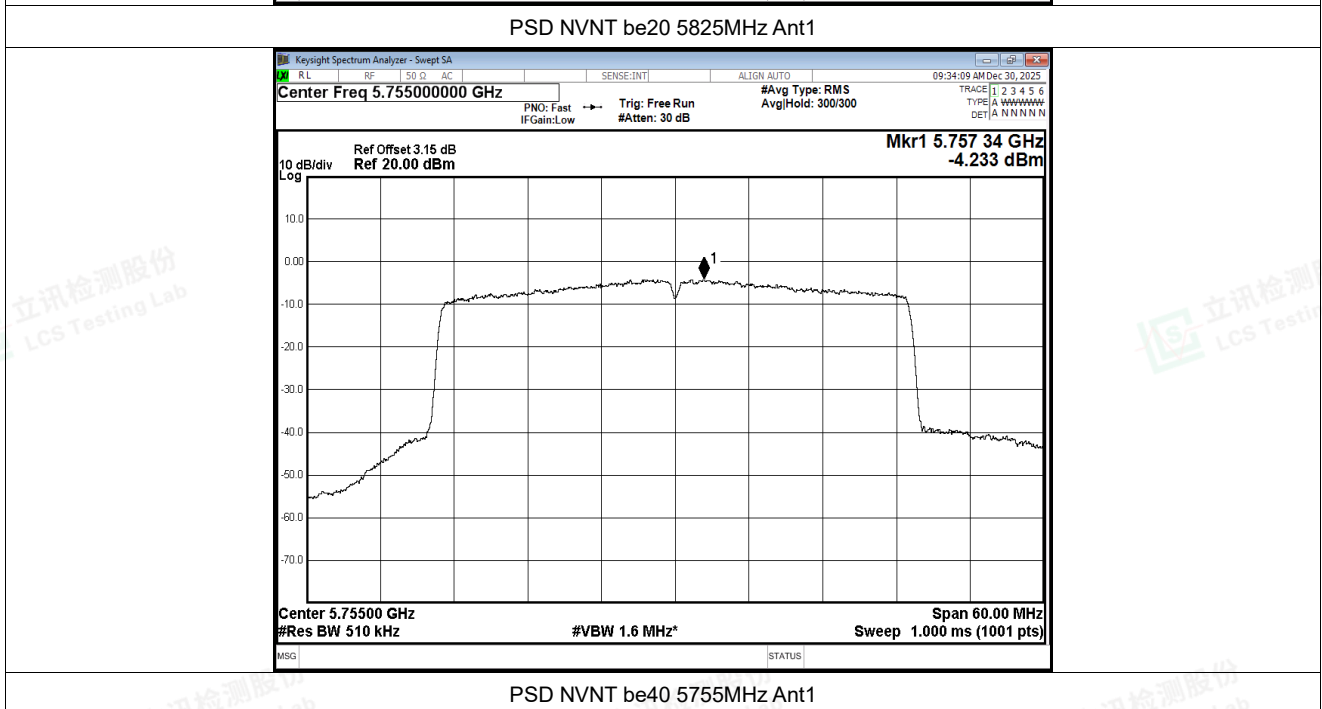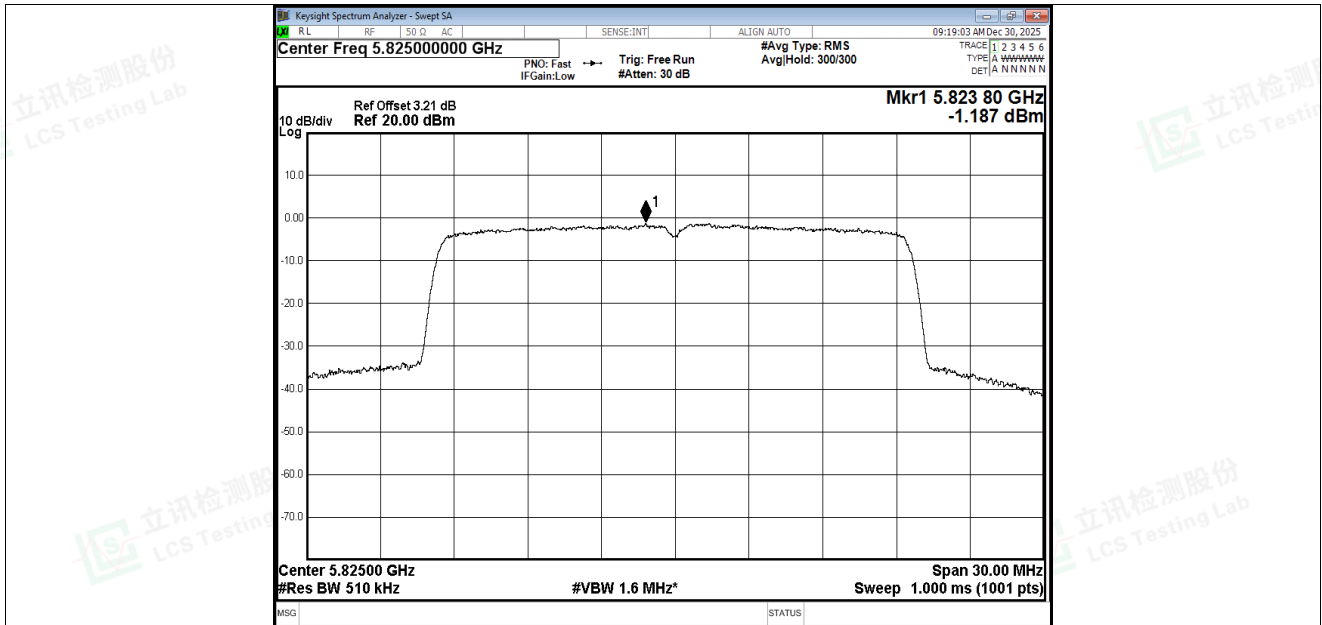


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

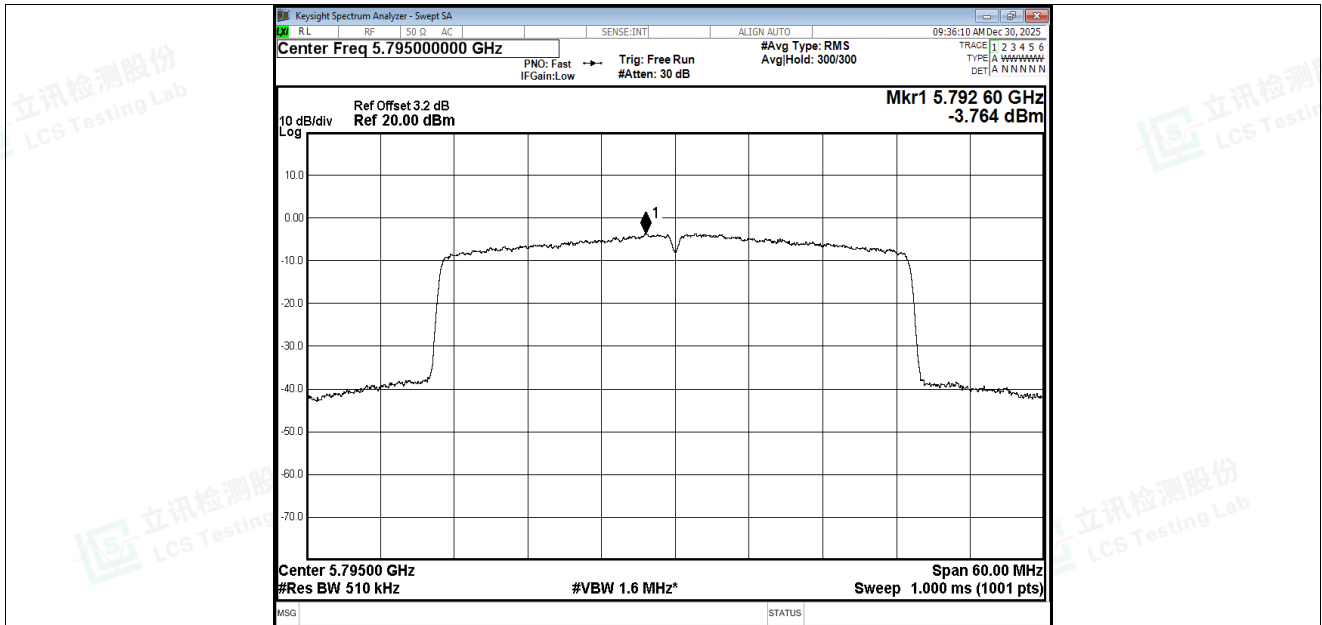

PSD NVNT be40 5795MHz Ant1

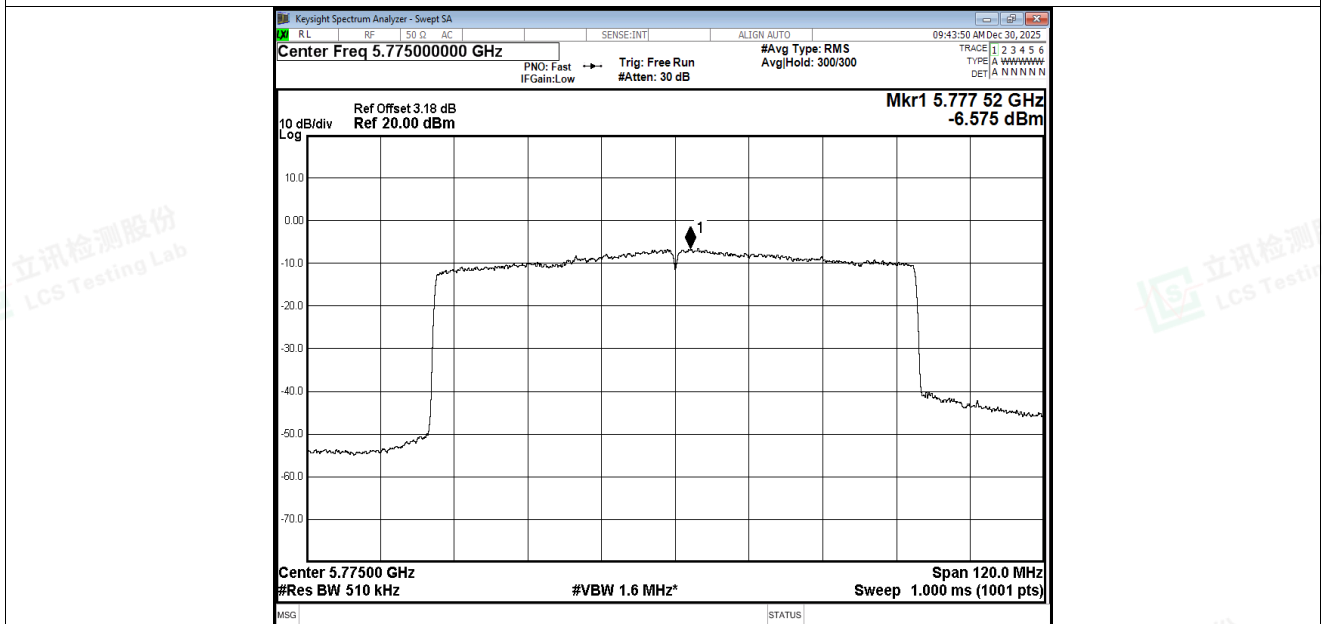

PSD NVNT be80 5775MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

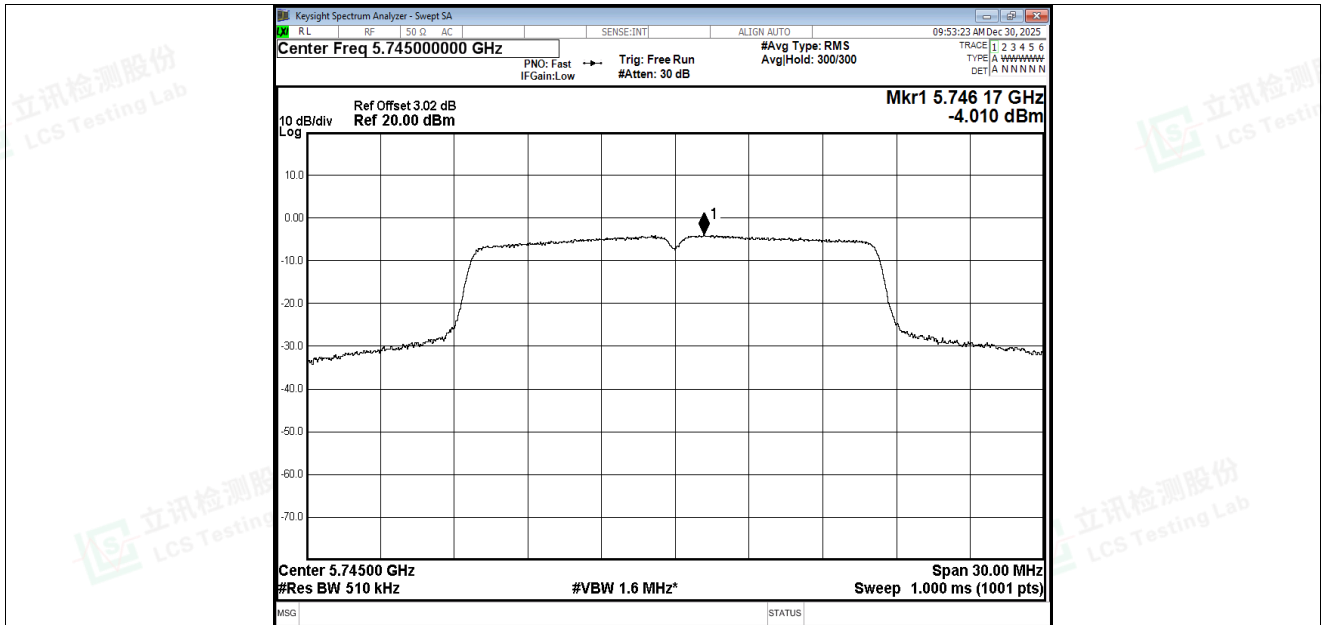

PSD NVNT a 5745MHz Ant2

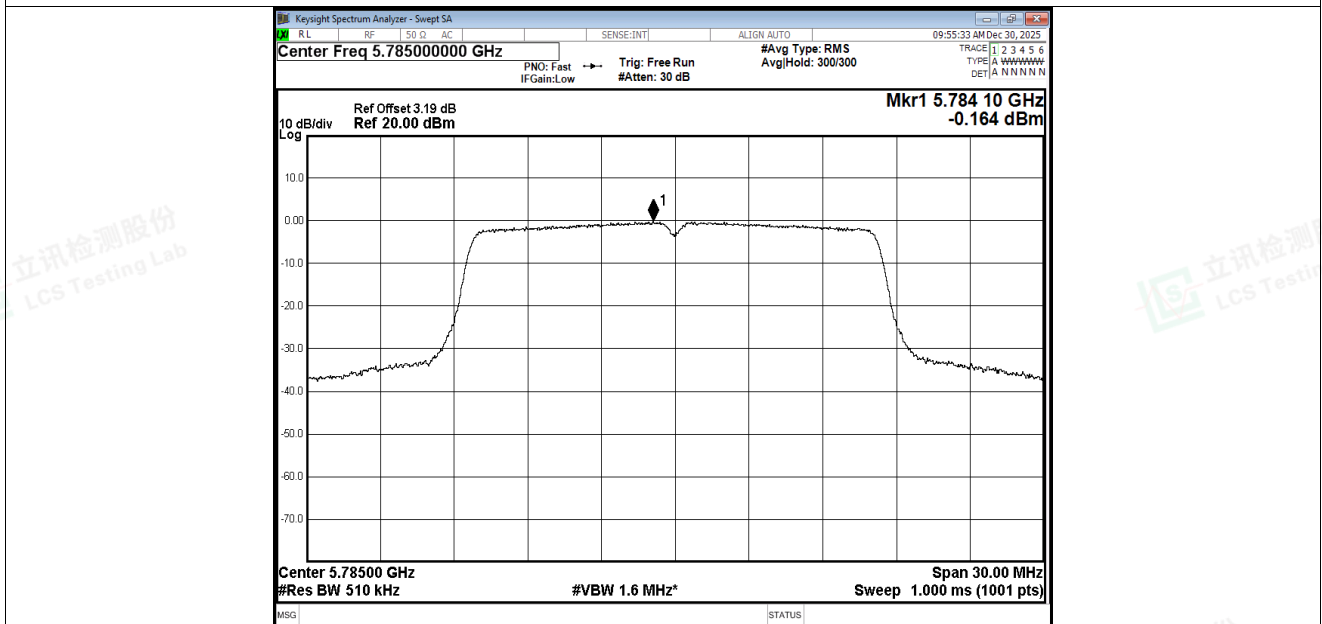

PSD NVNT a 5785MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

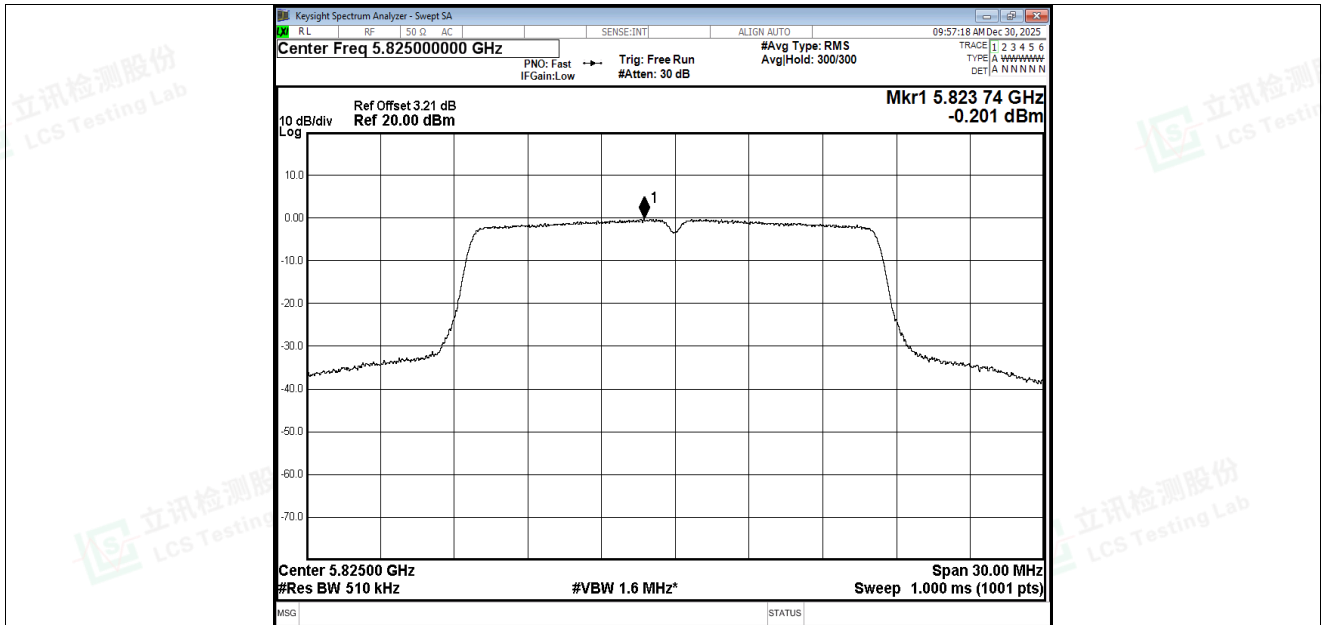

PSD NVNT a 5825MHz Ant2

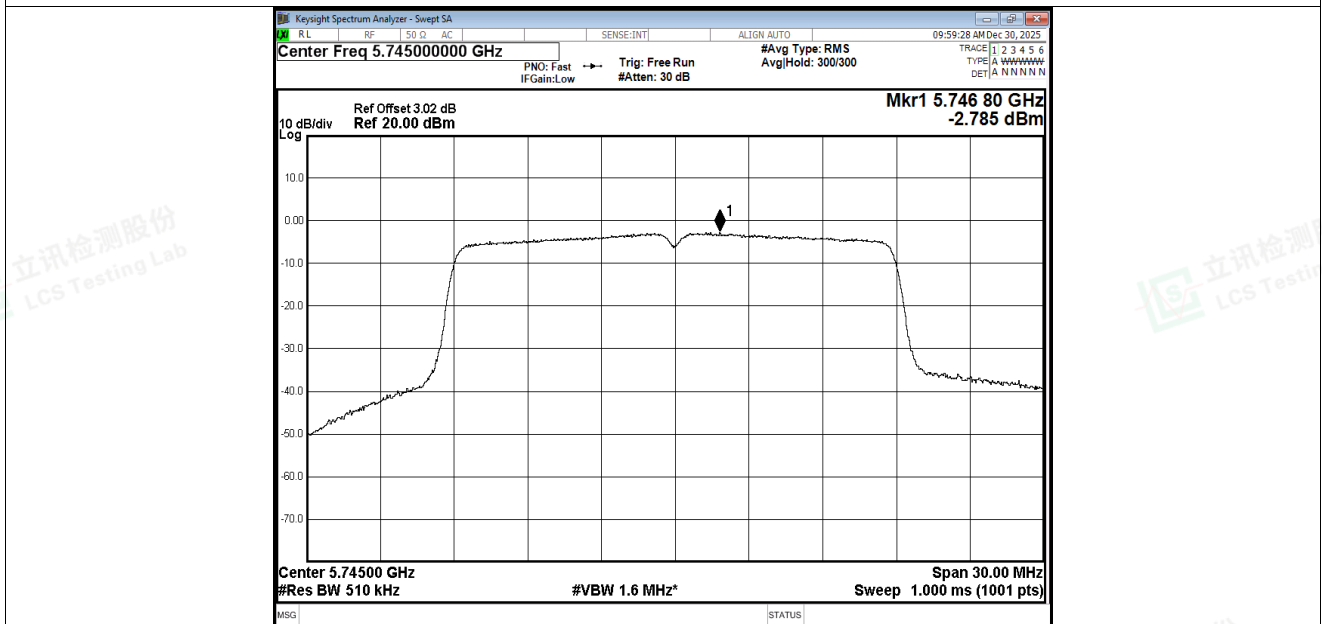

PSD NVNT n20 5745MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

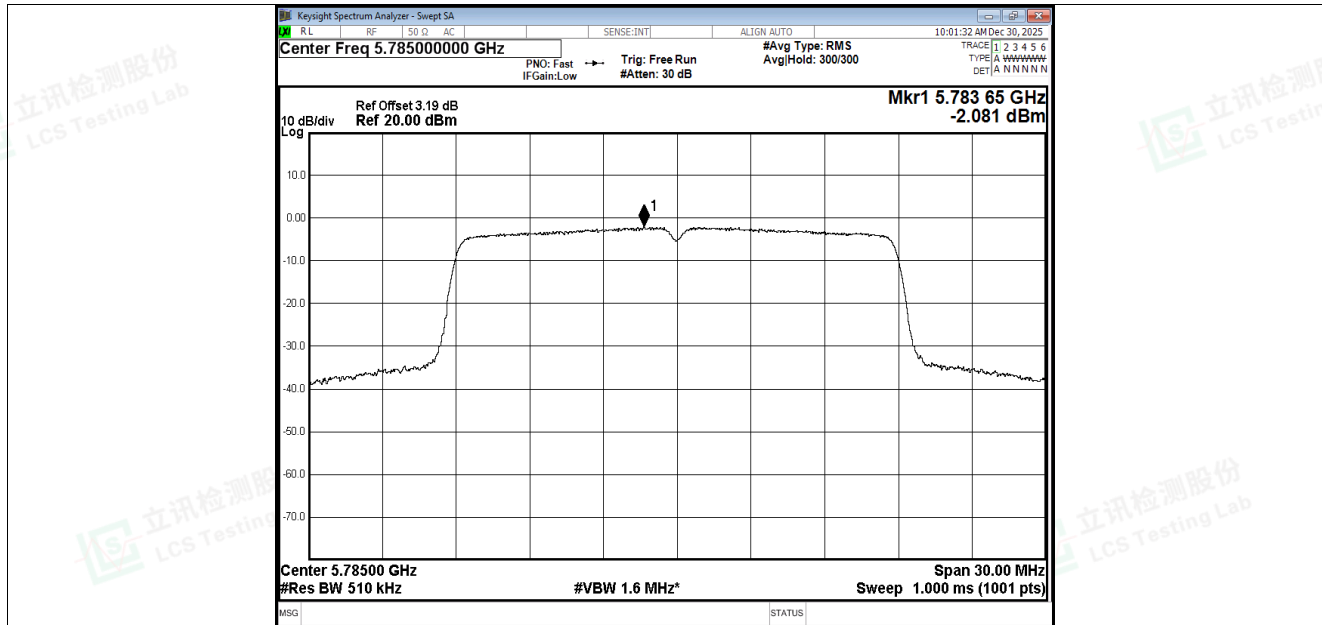

PSD NVNT n20 5785MHz Ant2

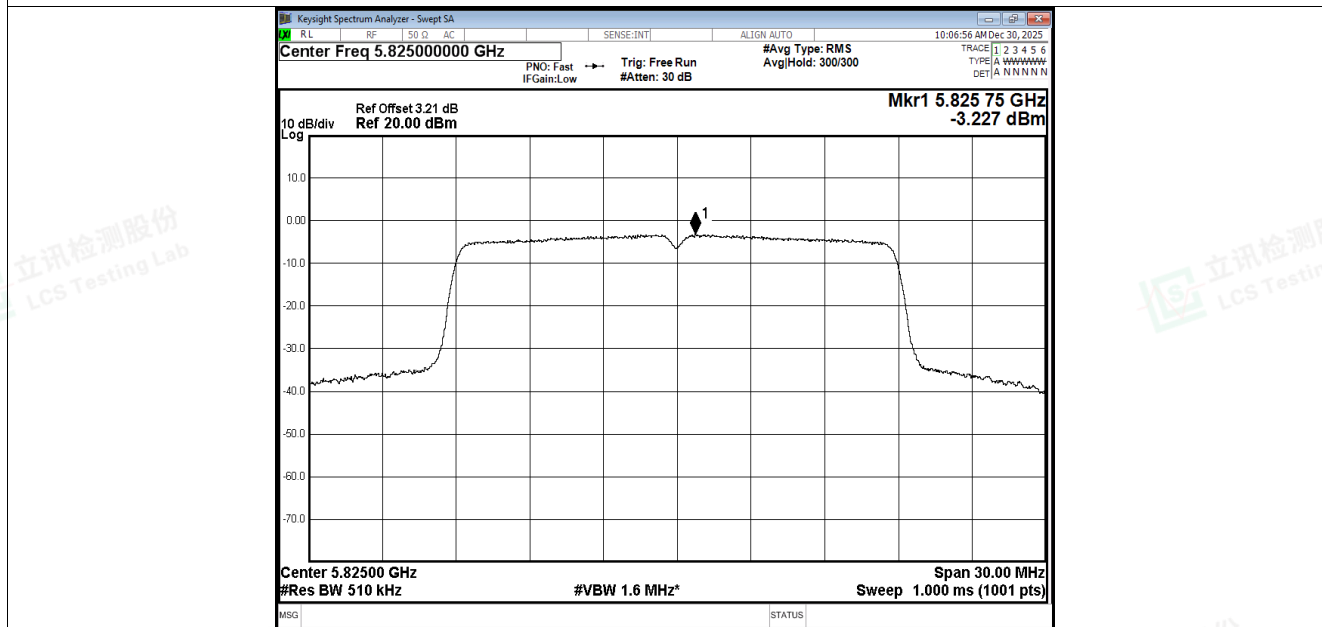

PSD NVNT n20 5825MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

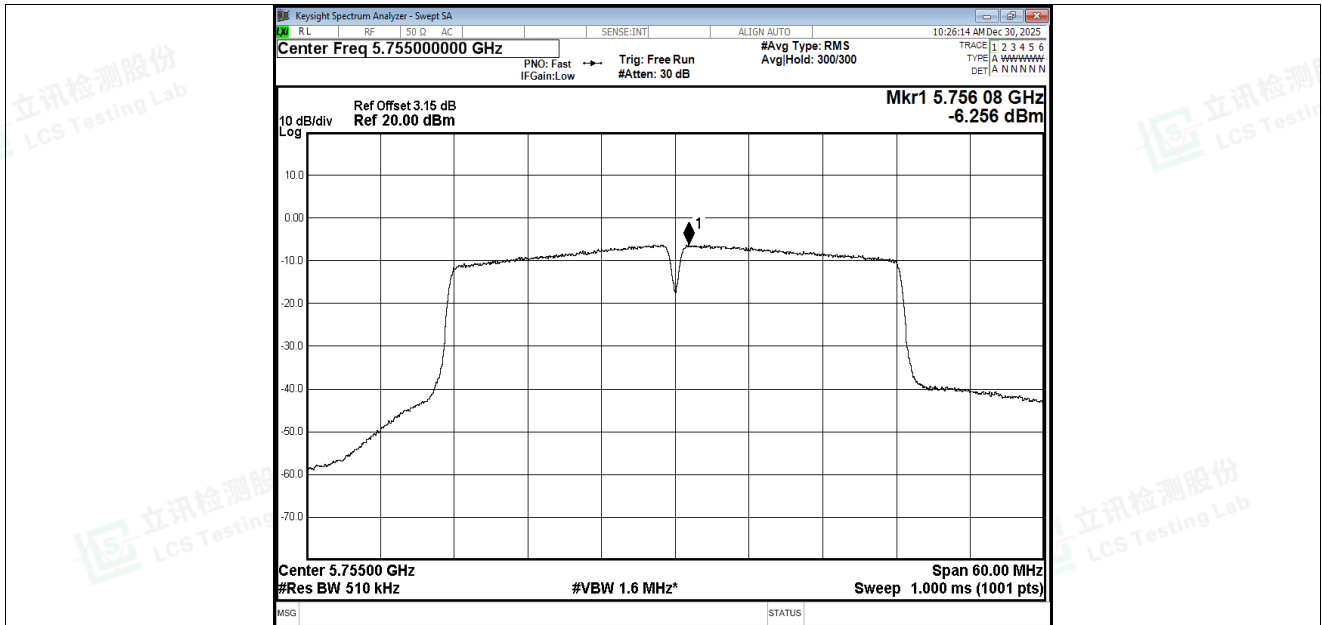

PSD NVNT n40 5755MHz Ant2

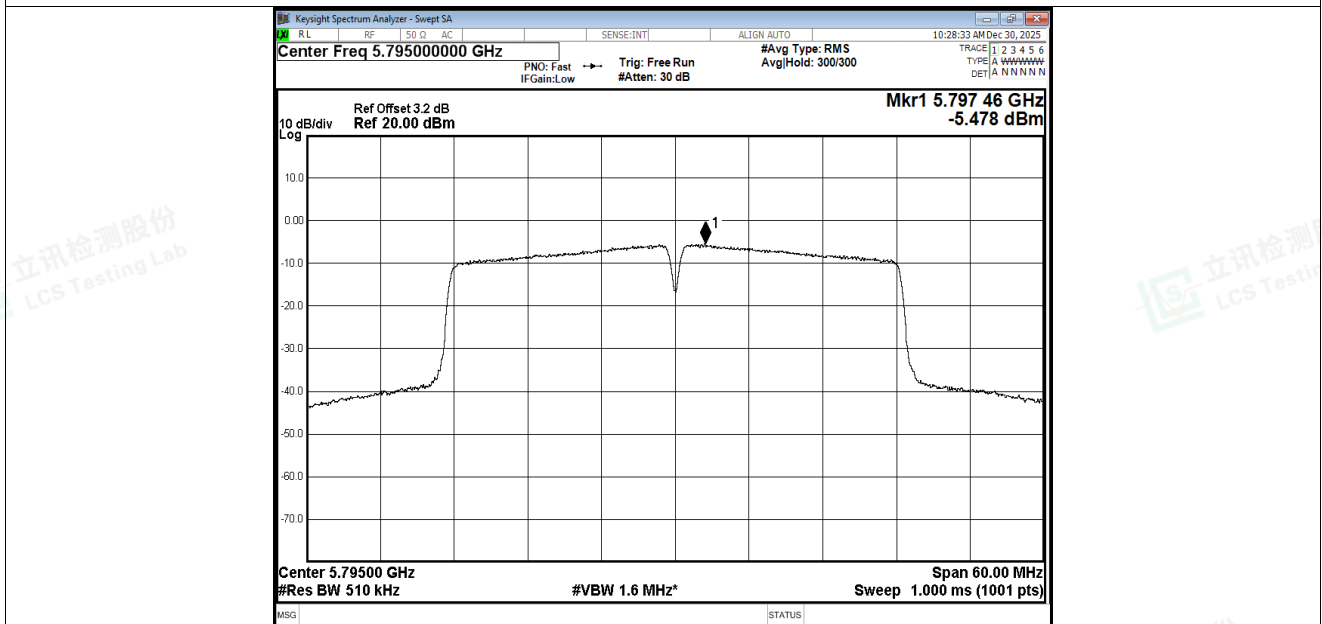

PSD NVNT n40 5795MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

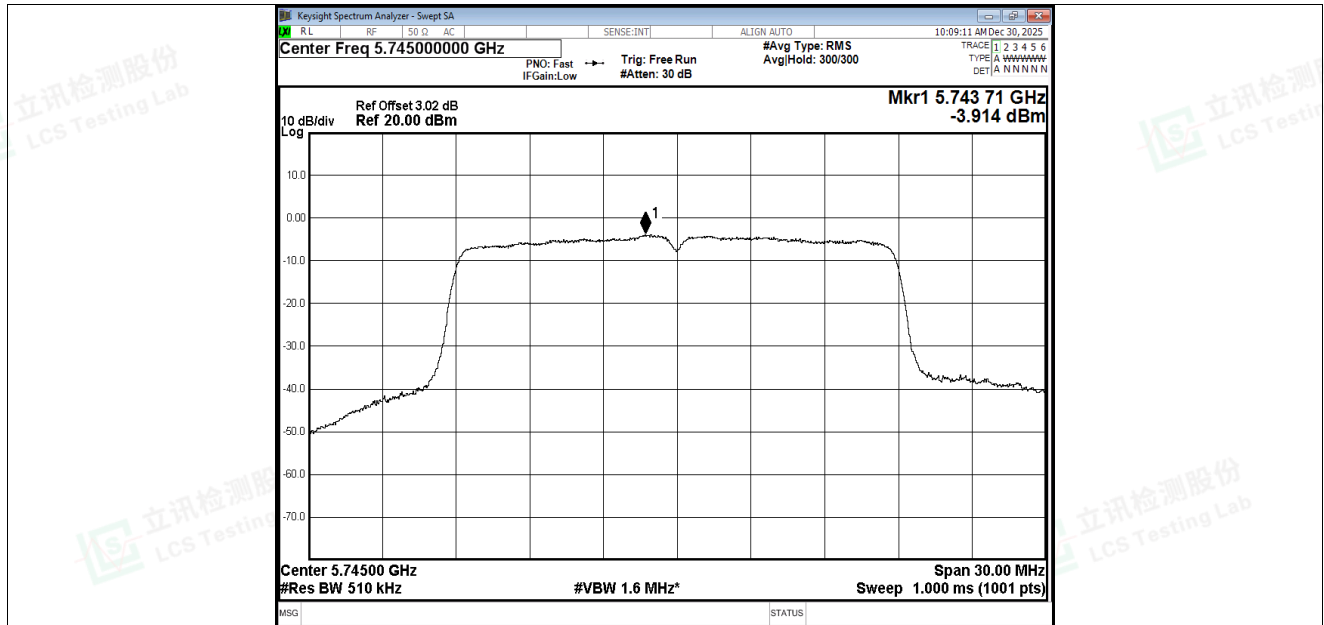

PSD NVNT ac20 5745MHz Ant2

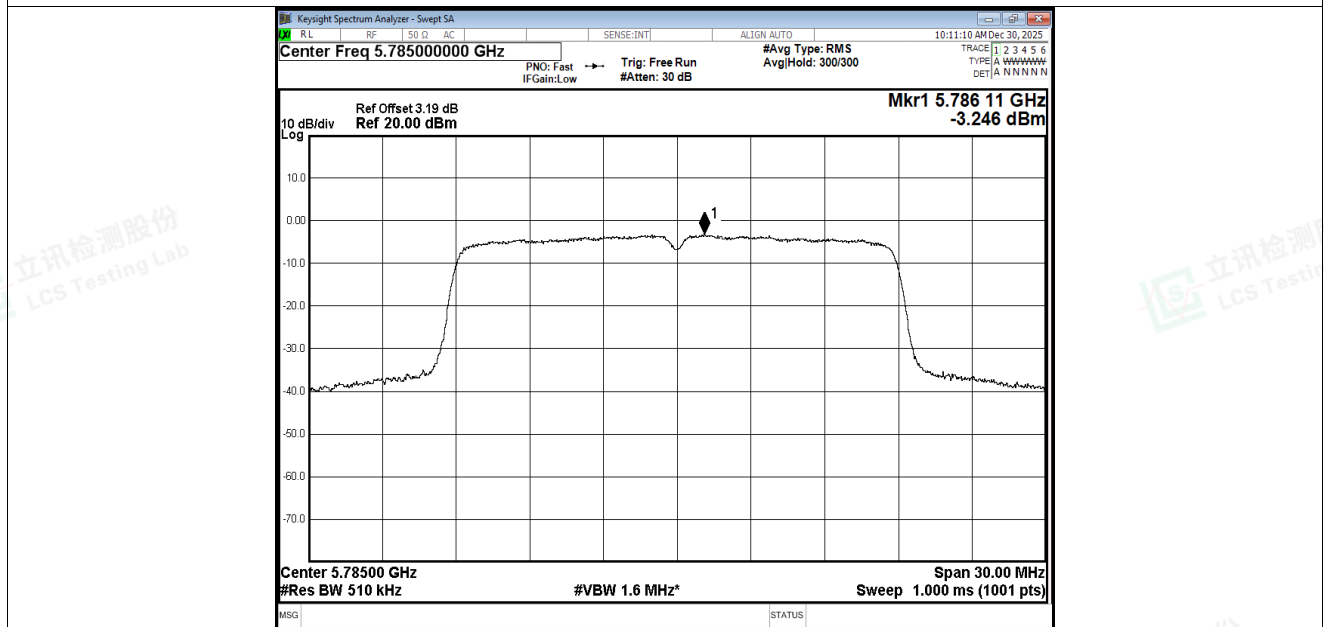

PSD NVNT ac20 5785MHz Ant2





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

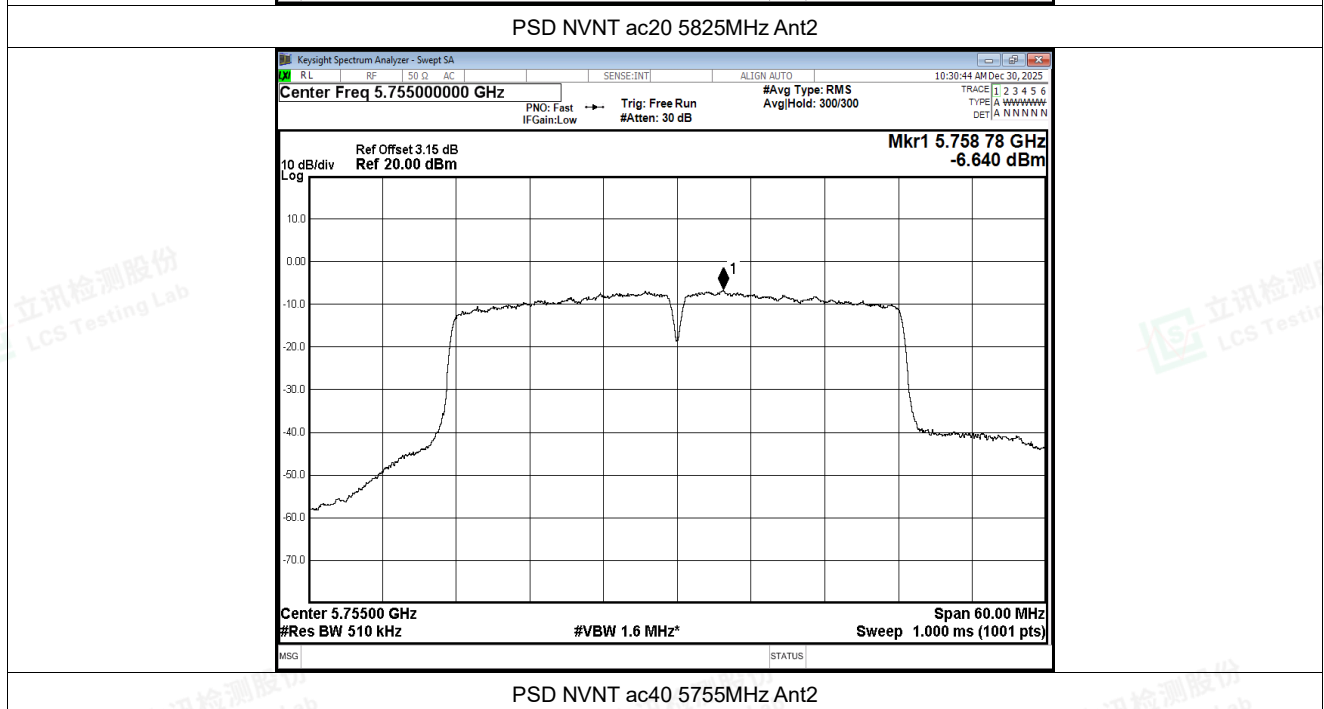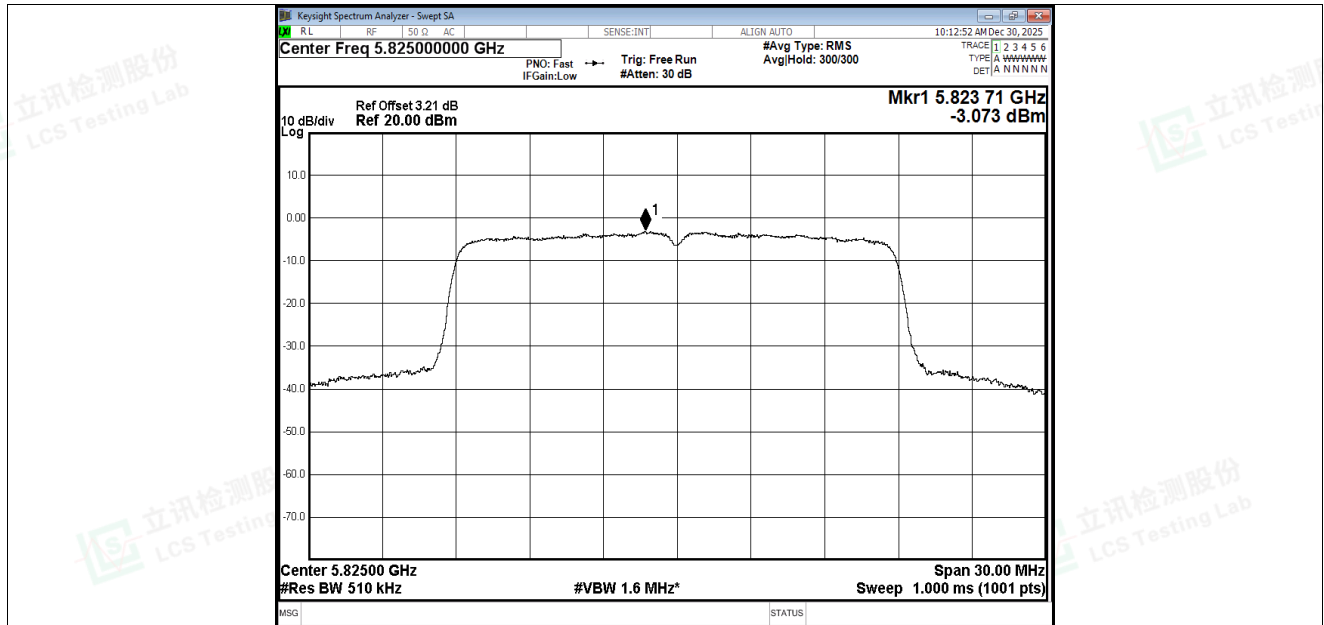


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

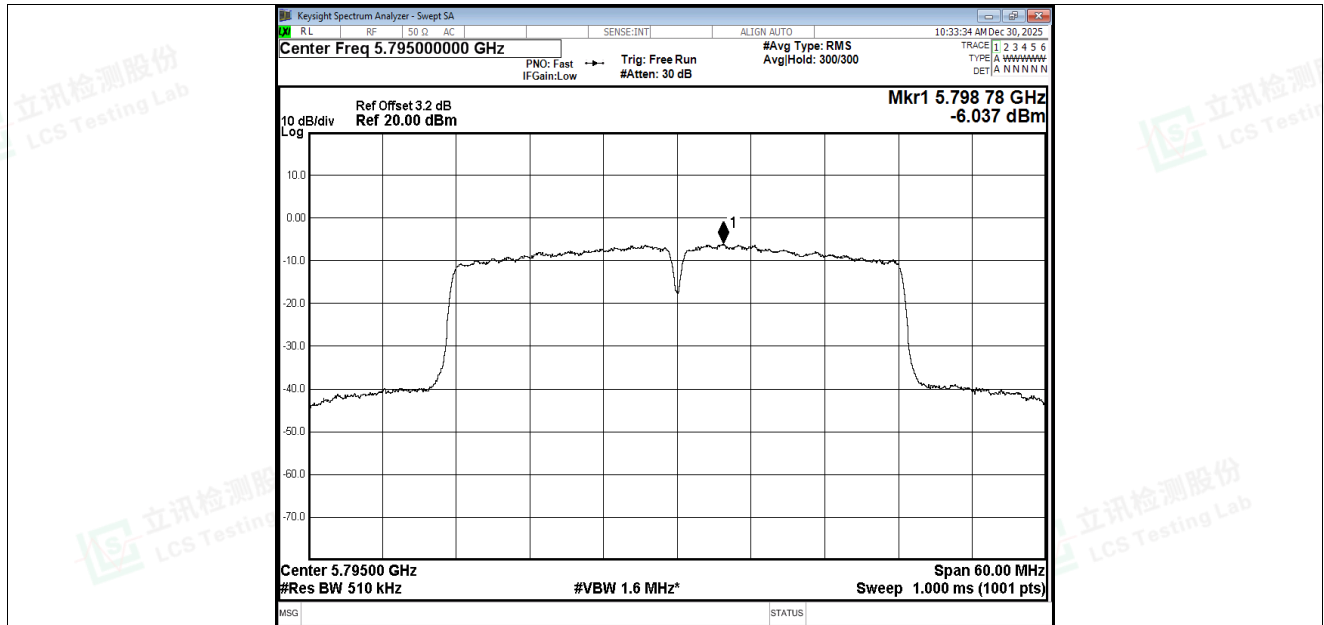

PSD NVNT ac40 5795MHz Ant2

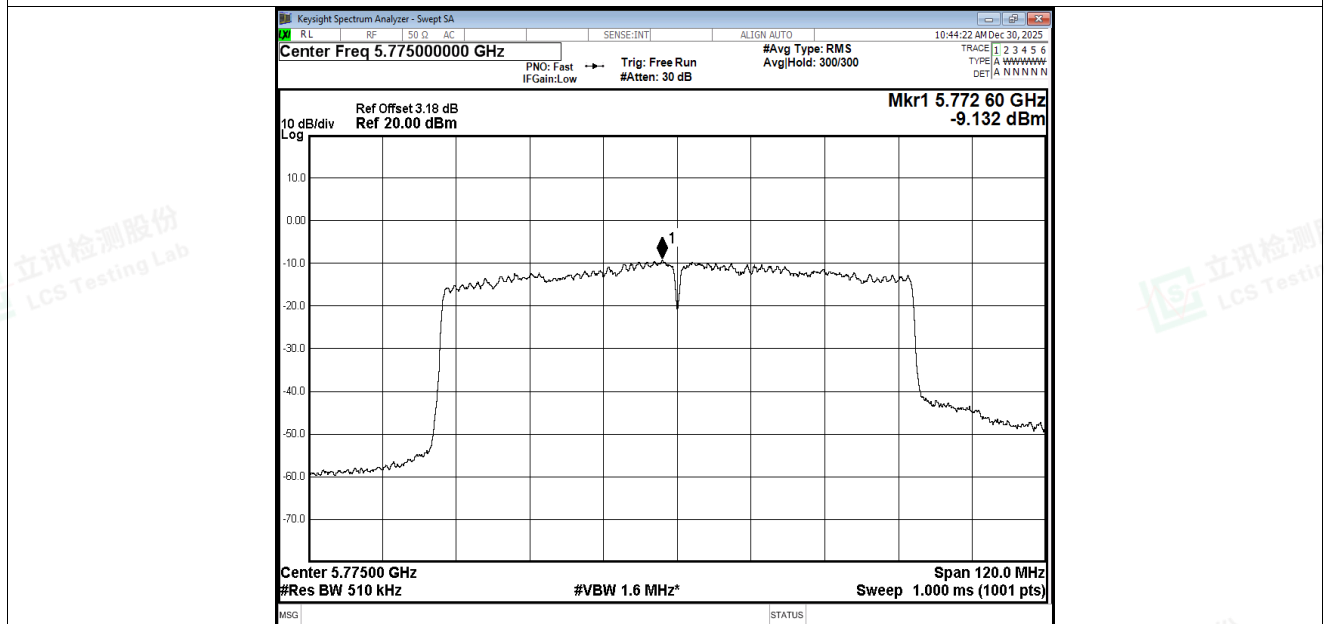

PSD NVNT ac80 5775MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

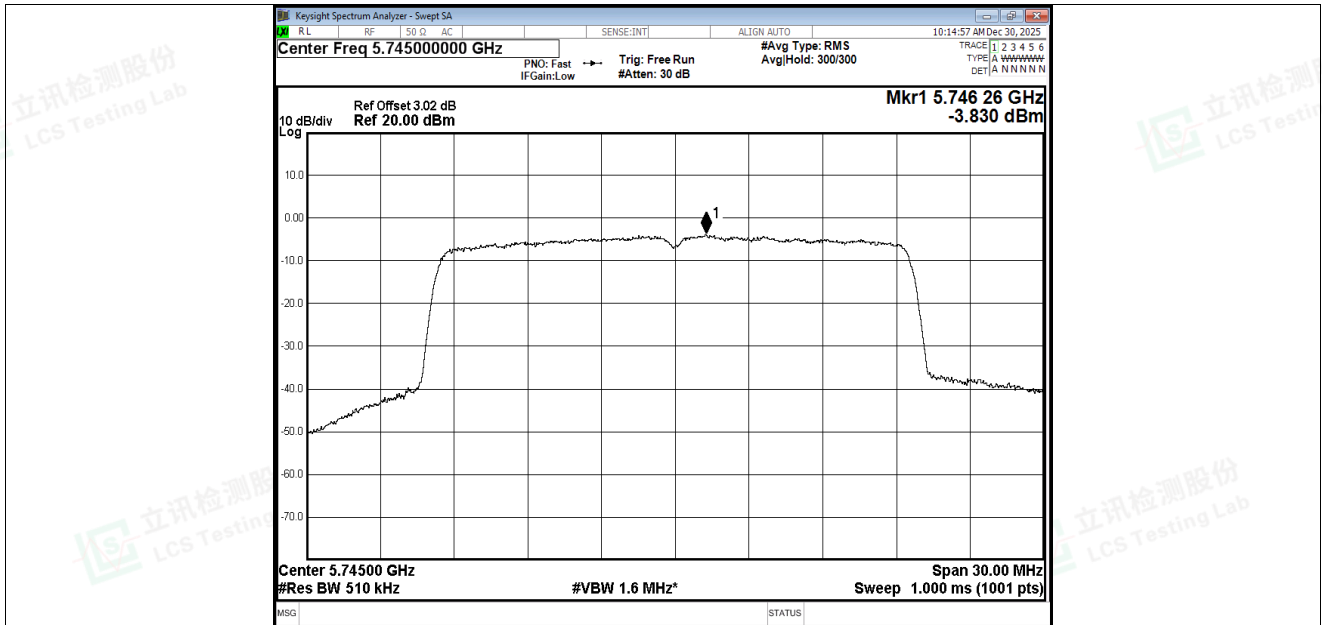

PSD NVNT ax20 5745MHz Ant2

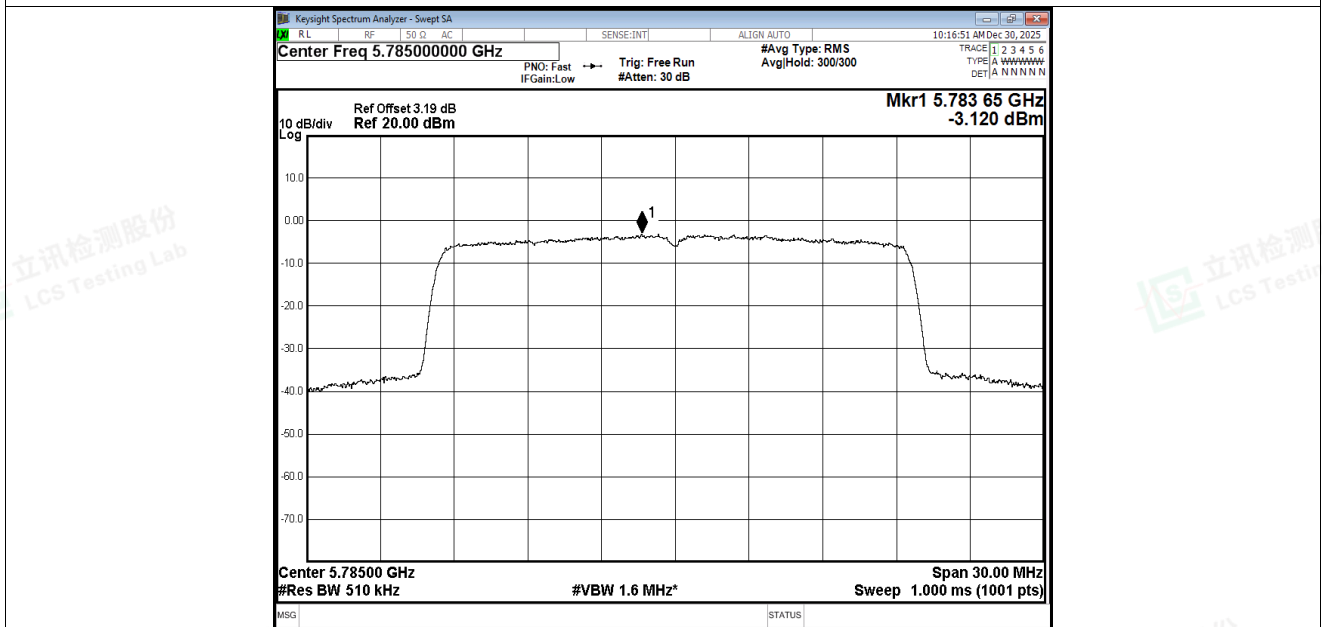

PSD NVNT ax20 5785MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

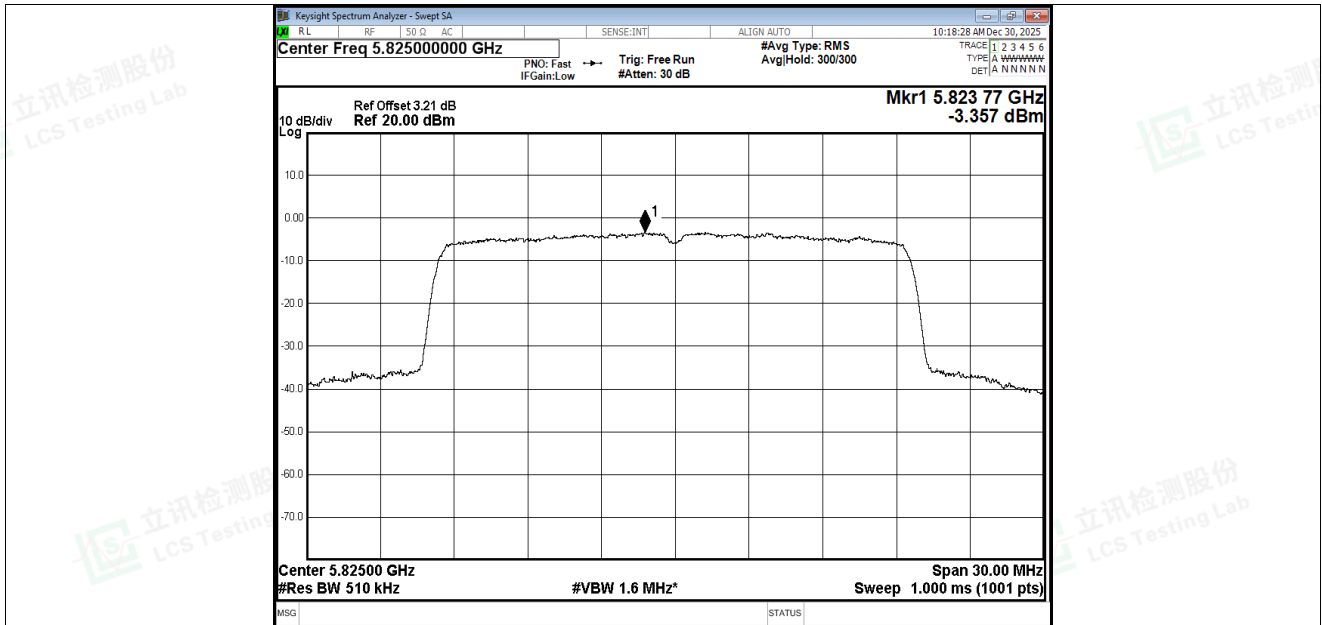

PSD NVNT ax20 5825MHz Ant2

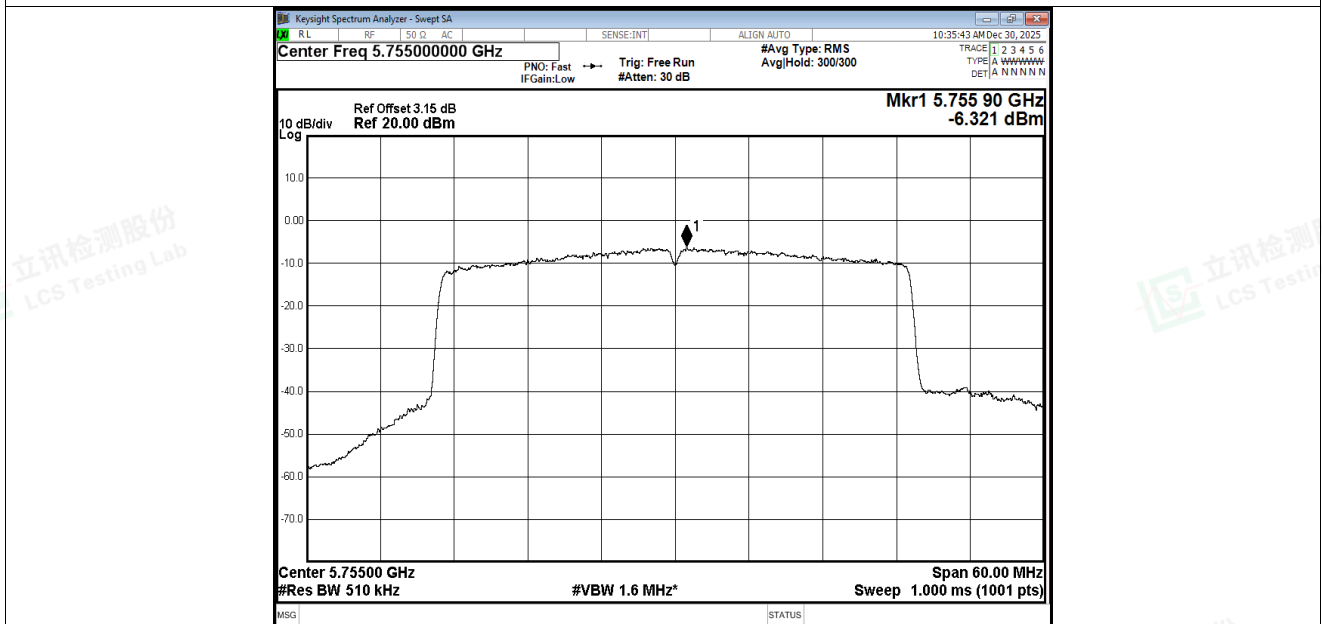

PSD NVNT ax40 5755MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

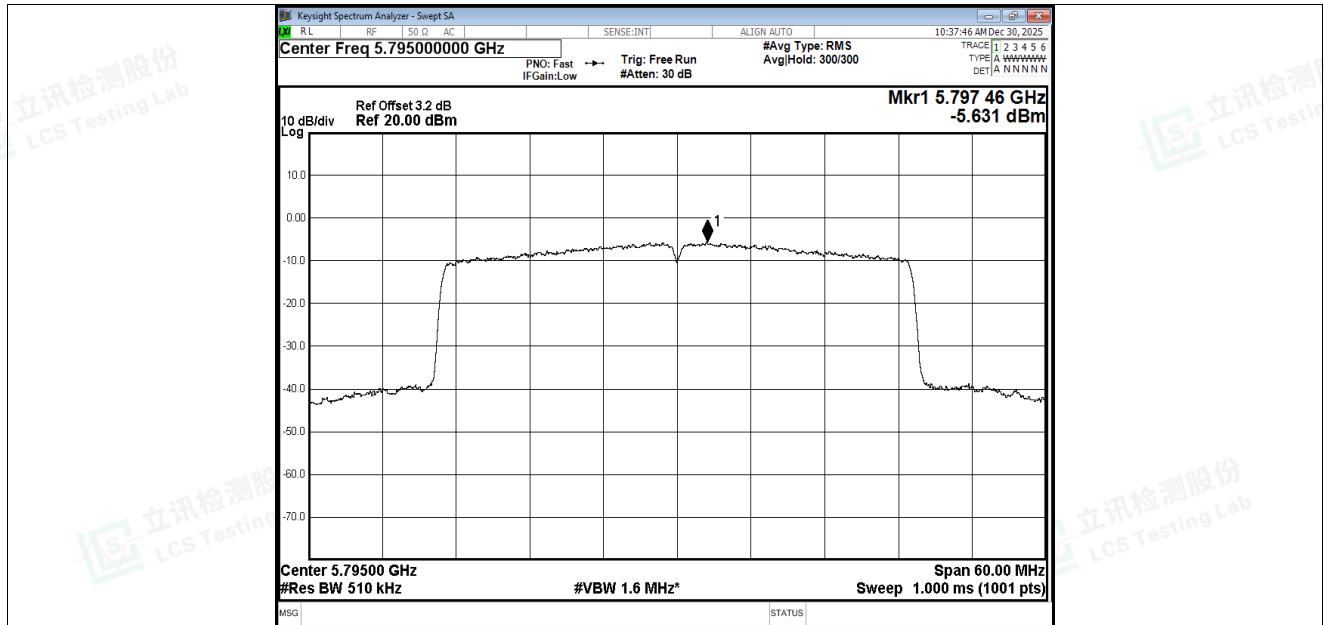

PSD NVNT ax40 5795MHz Ant2

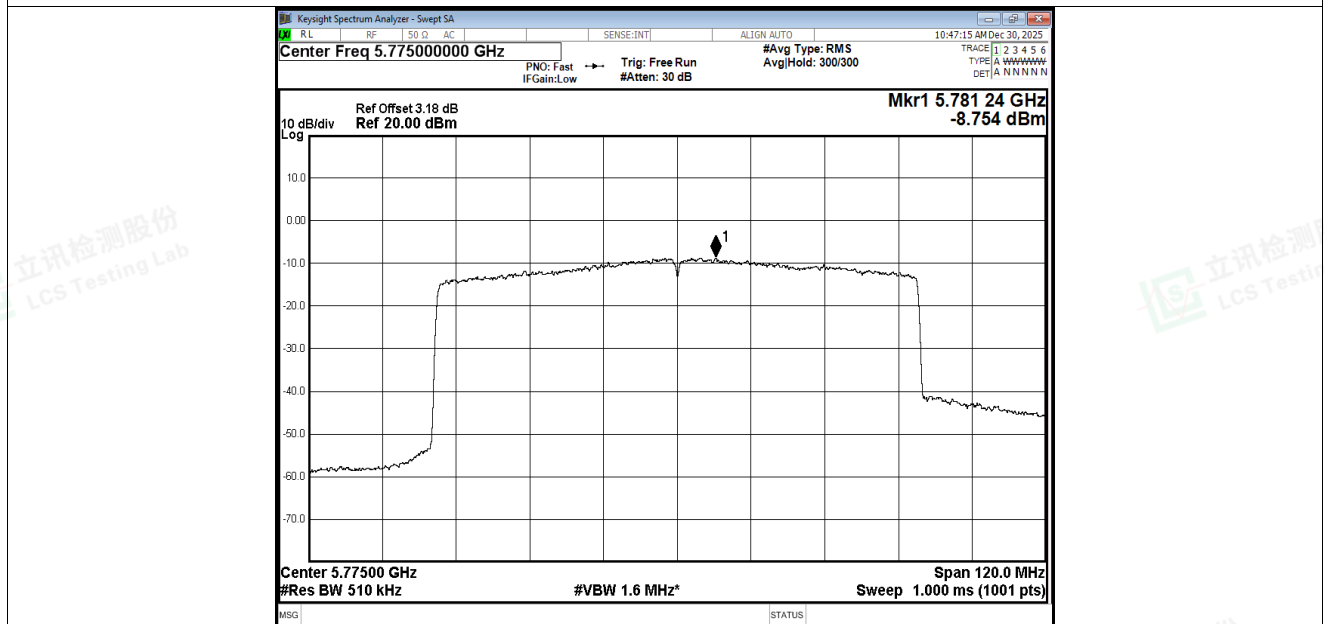

PSD NVNT ax80 5775MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

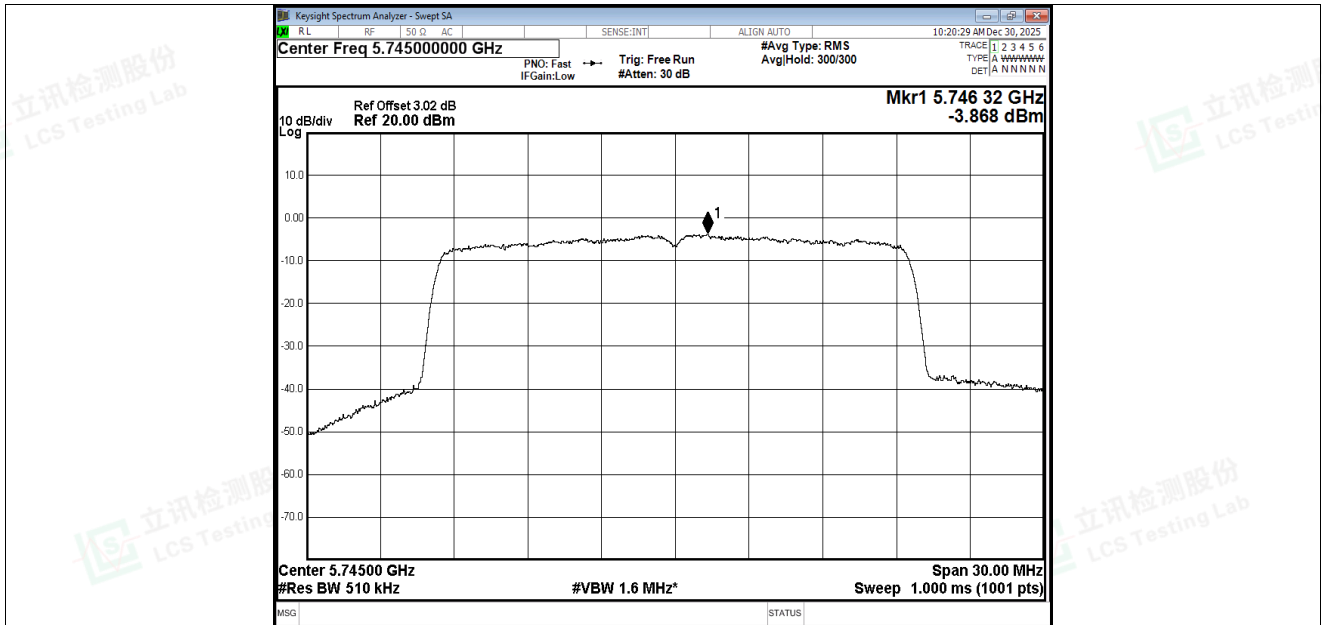

PSD NVNT be20 5745MHz Ant2

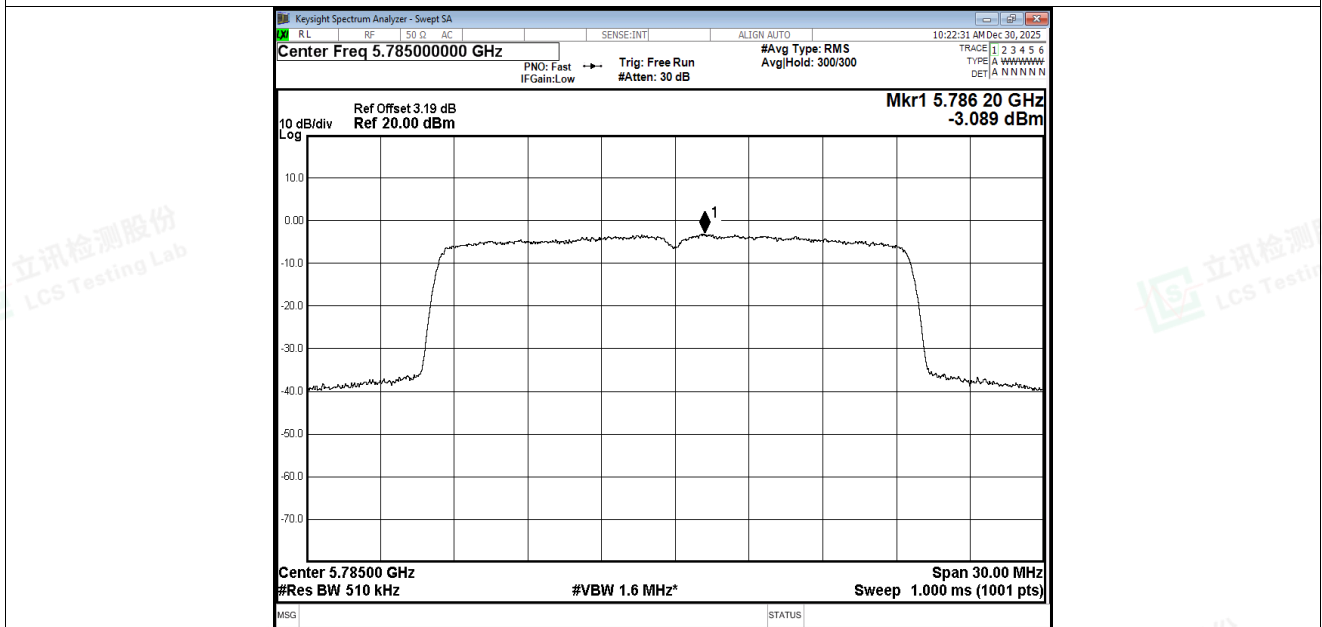

PSD NVNT be20 5785MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

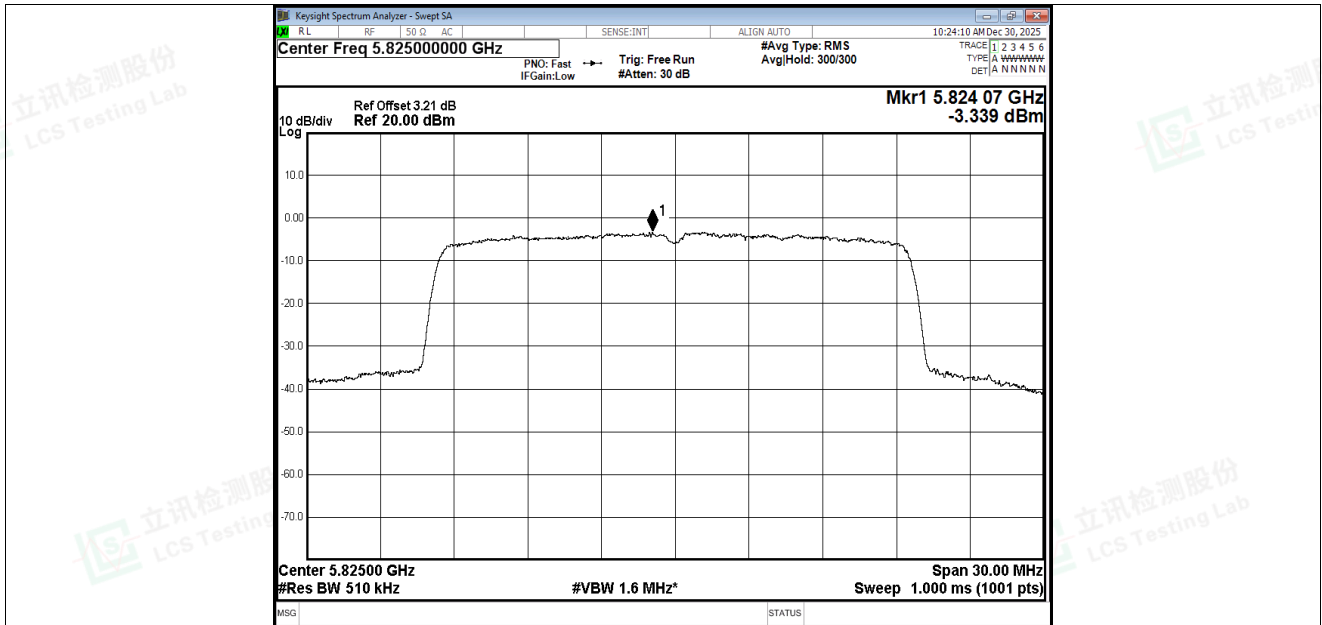

PSD NVNT be20 5825MHz Ant2

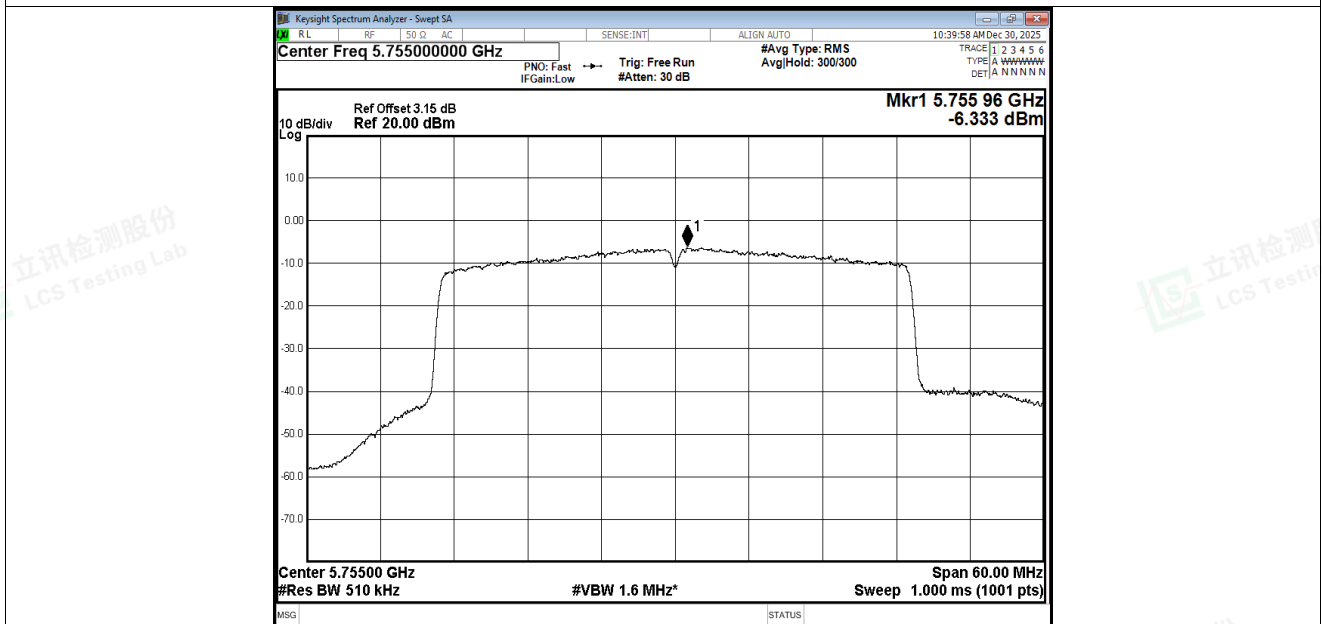

PSD NVNT be40 5755MHz Ant2





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

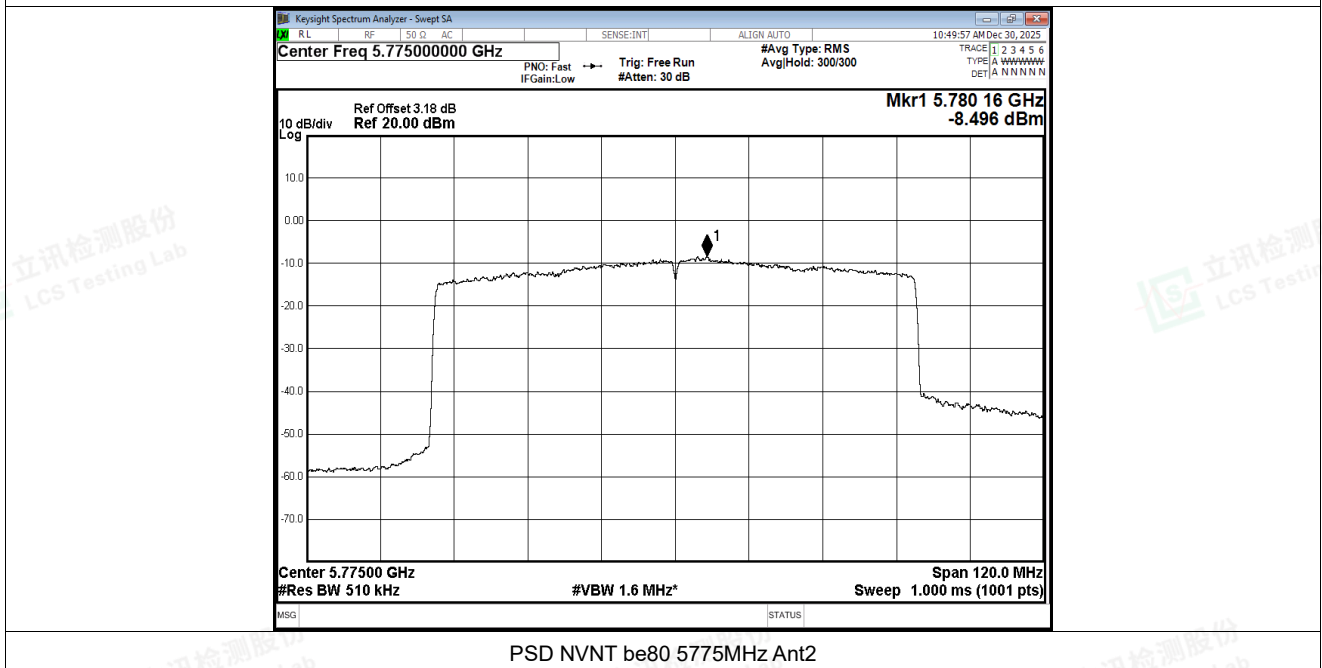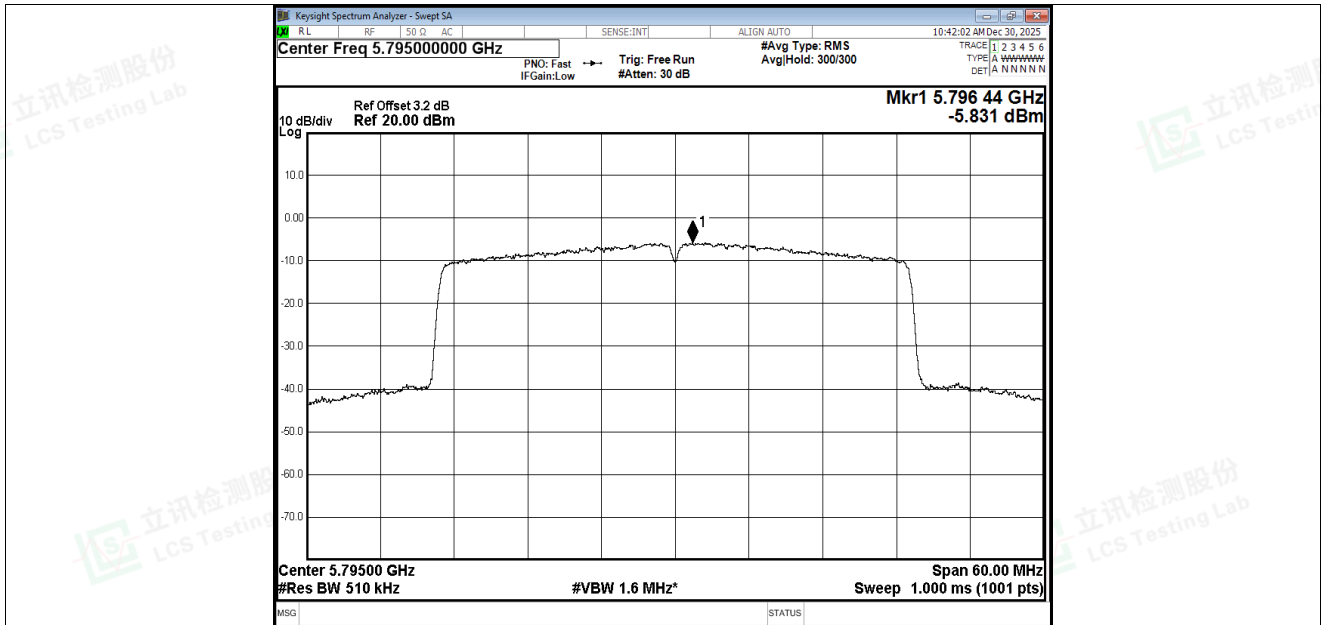


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

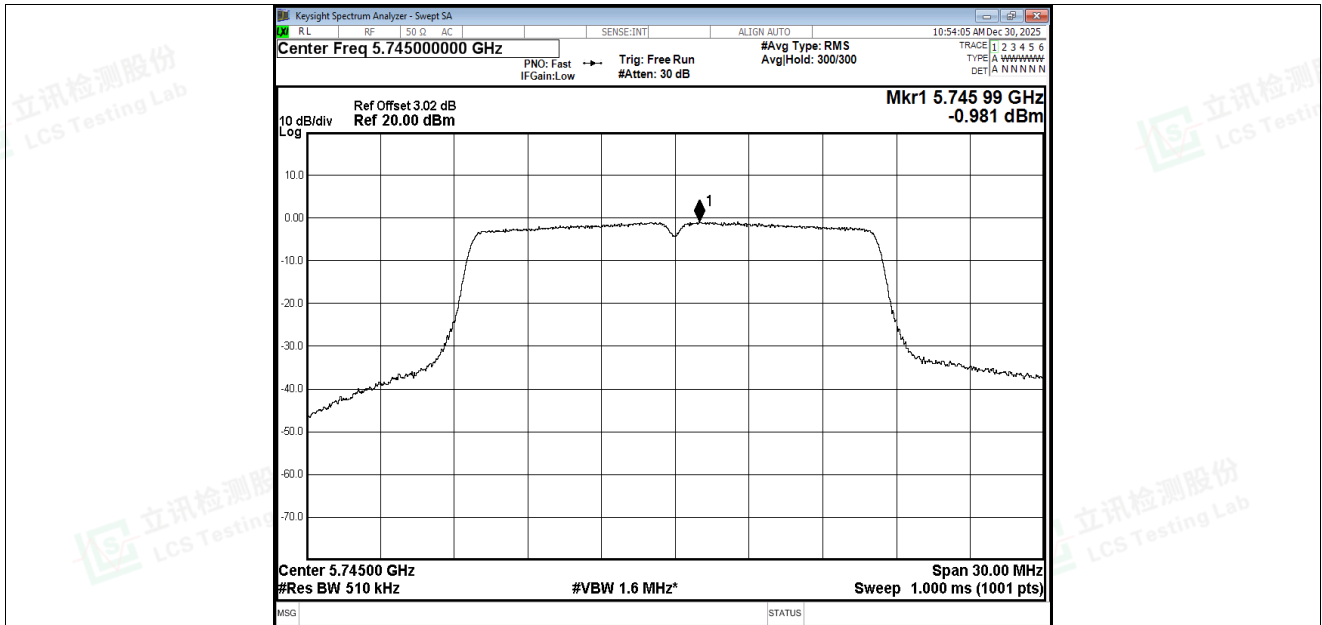

PSD NVNT a 5745MHz Ant3

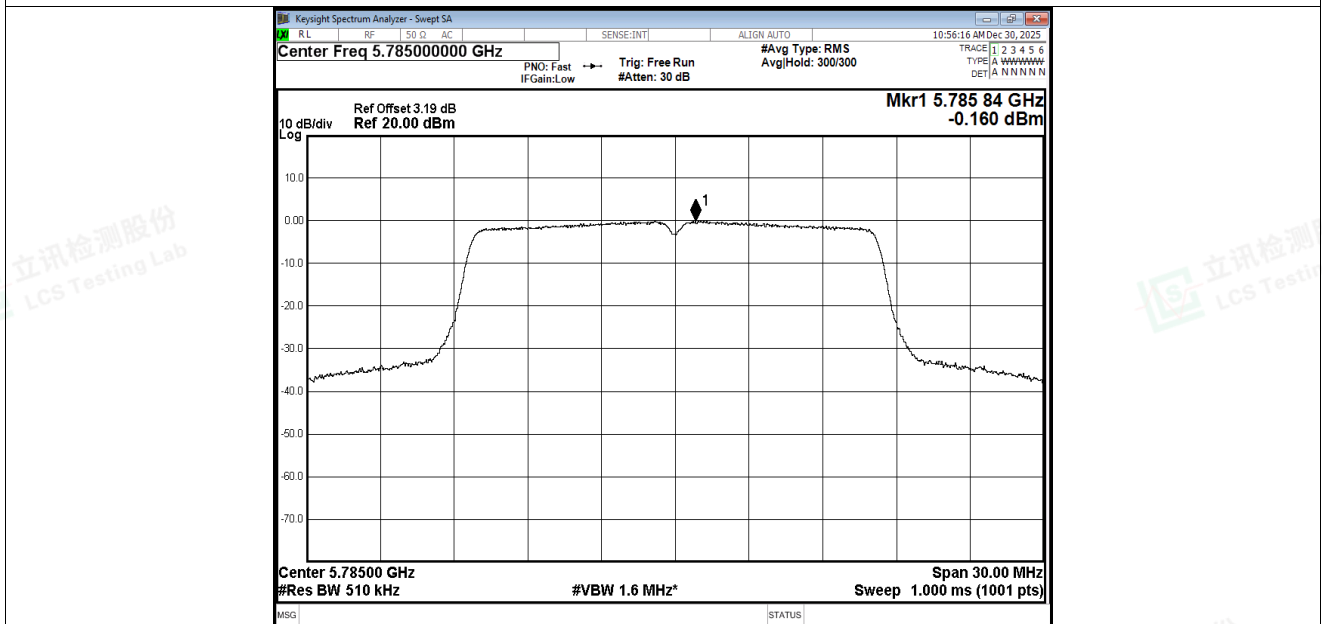

PSD NVNT a 5785MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

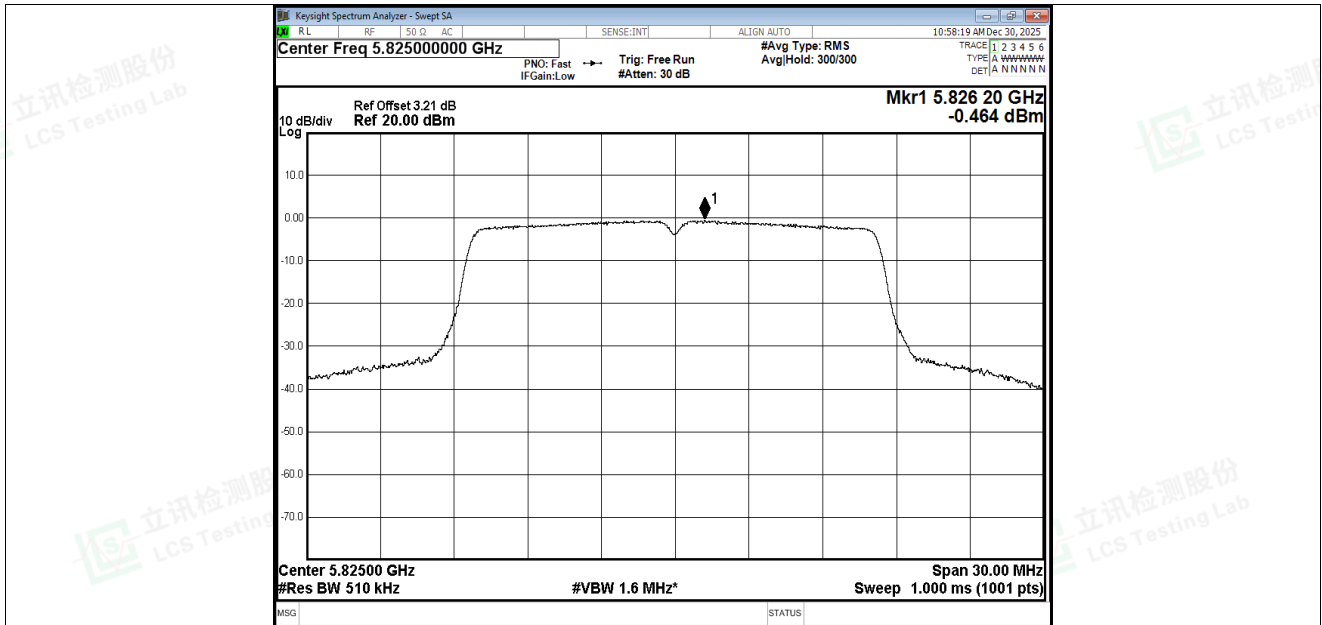

PSD NVNT a 5825MHz Ant3

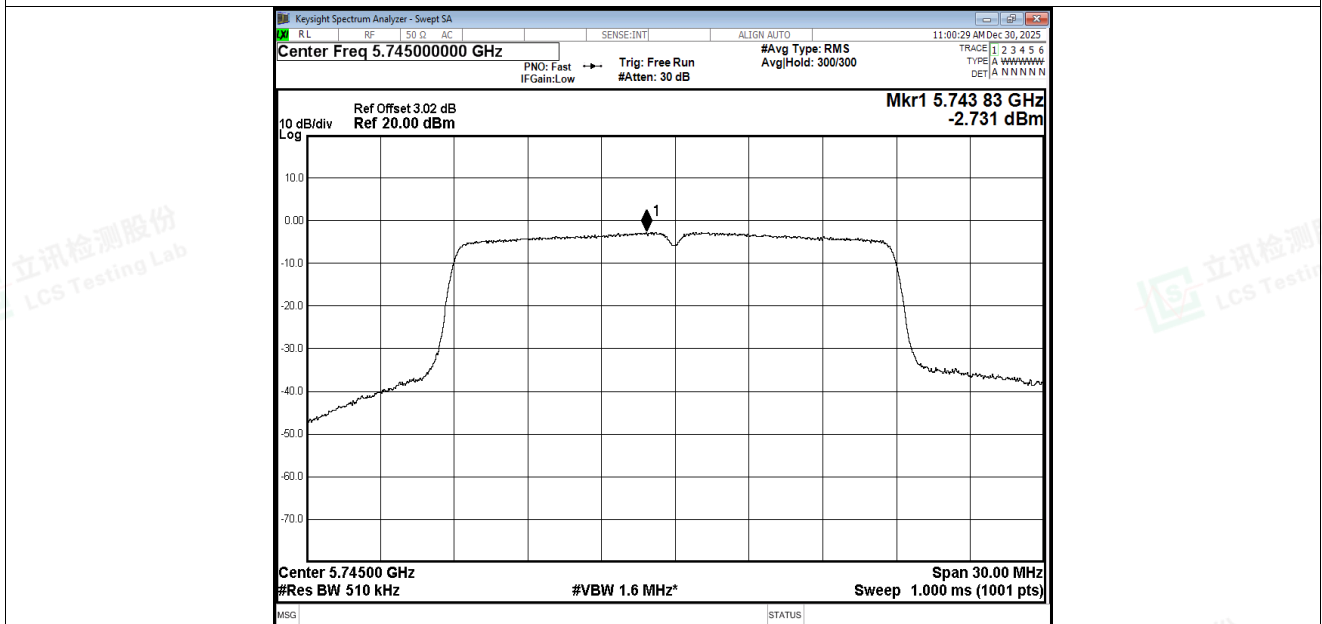

PSD NVNT n20 5745MHz Ant3





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

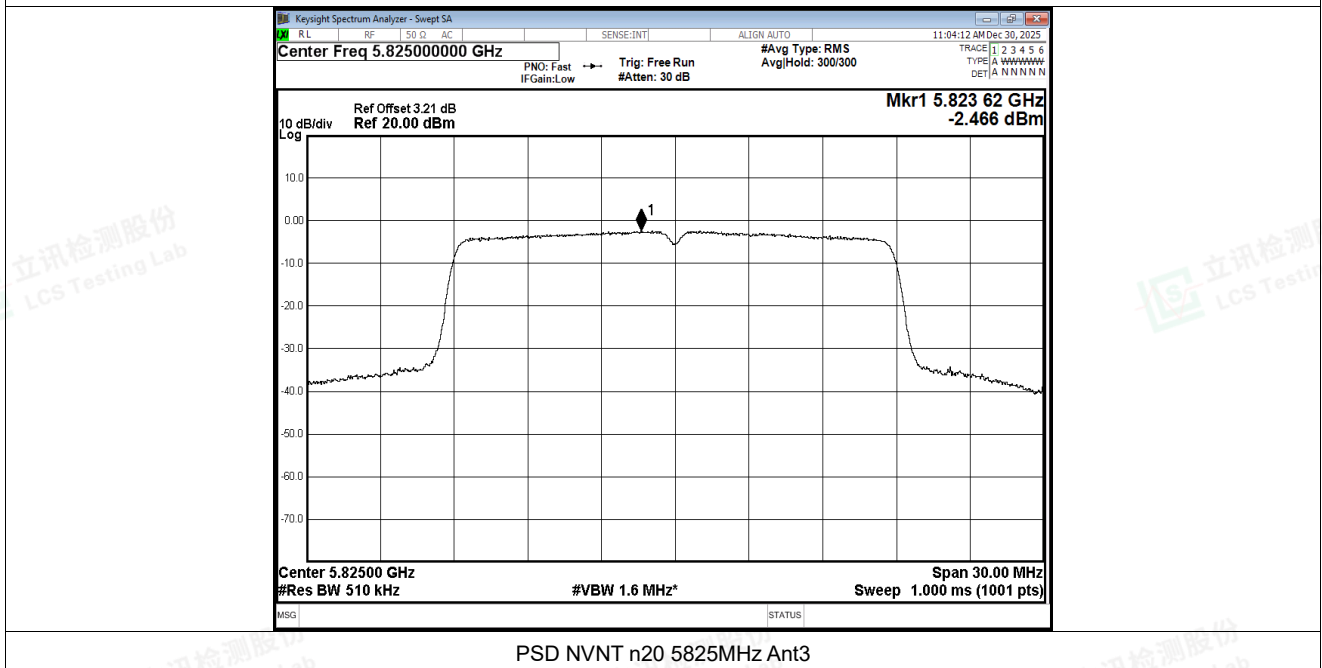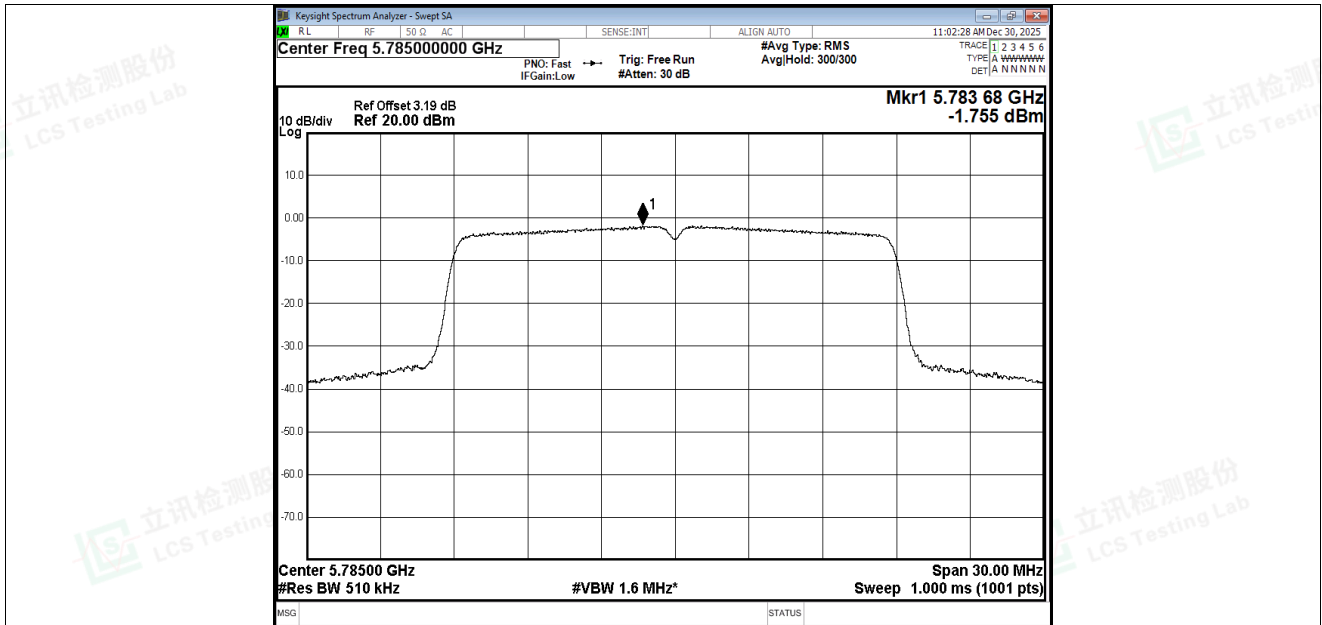


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

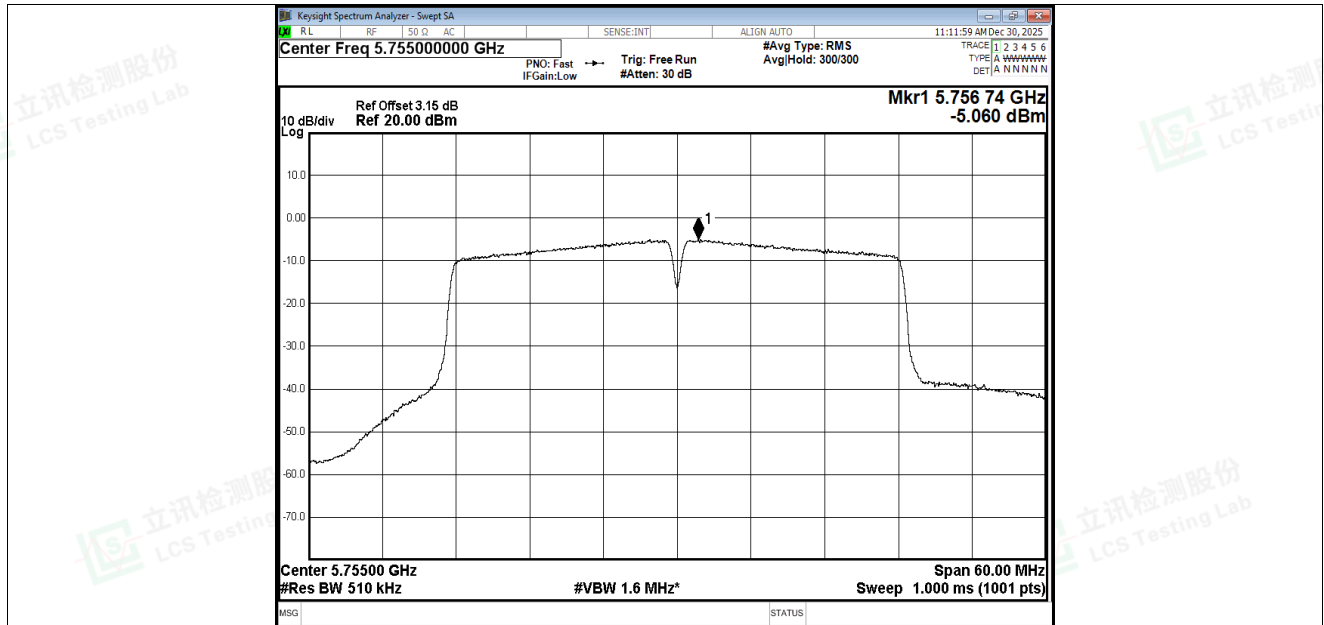

PSD NVNT n40 5755MHz Ant3

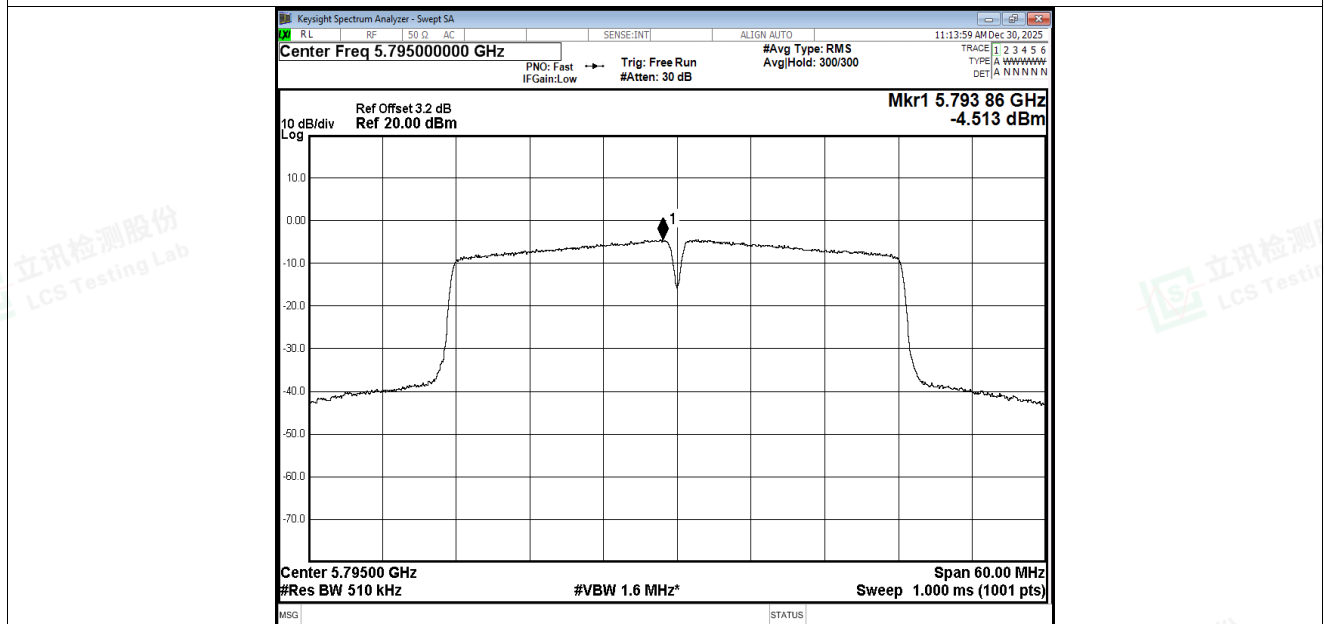

PSD NVNT n40 5795MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

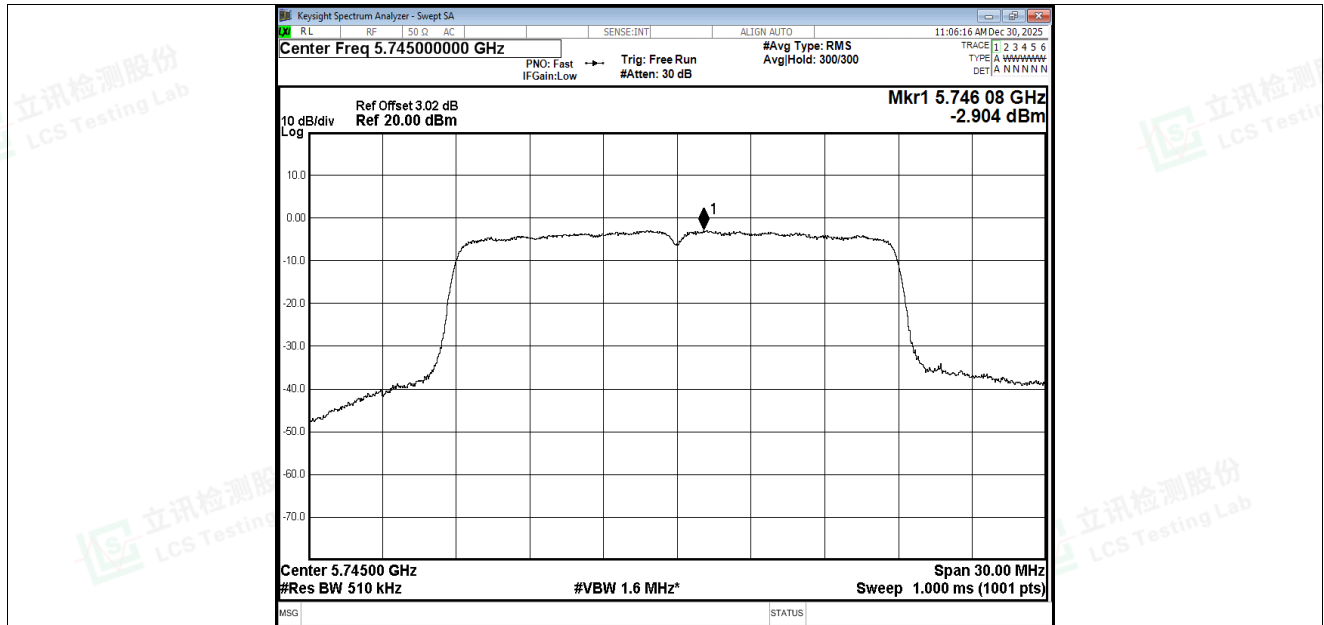

PSD NVNT ac20 5745MHz Ant3

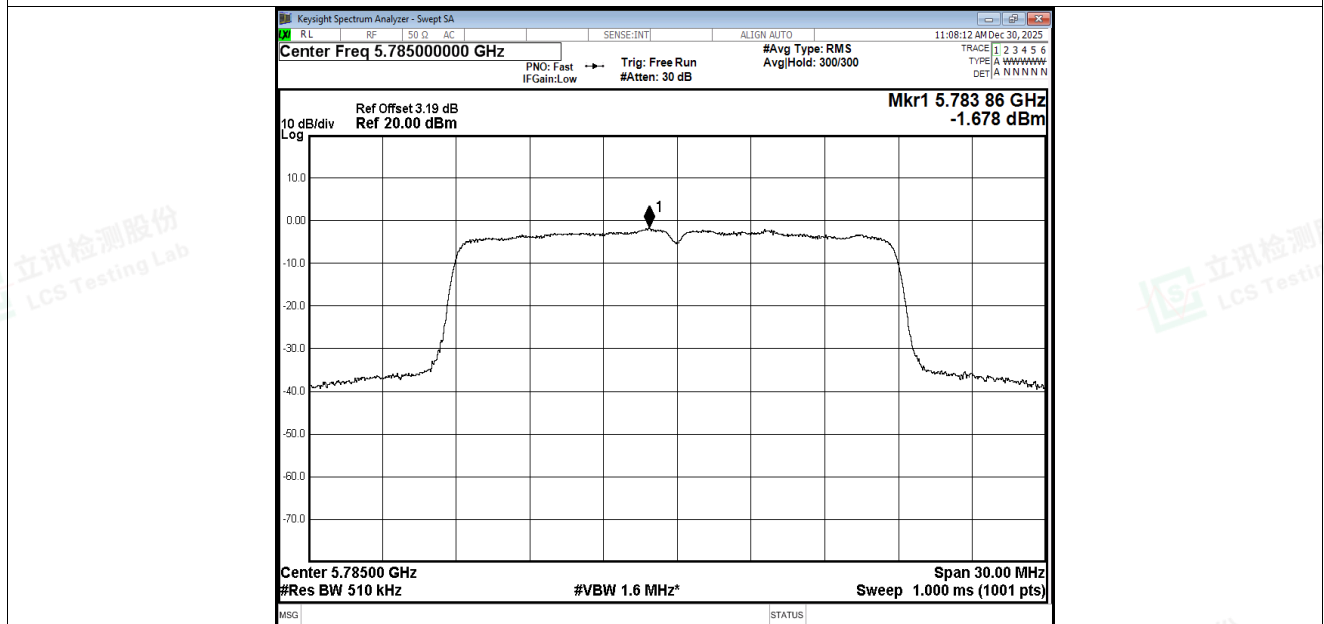

PSD NVNT ac20 5785MHz Ant3





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

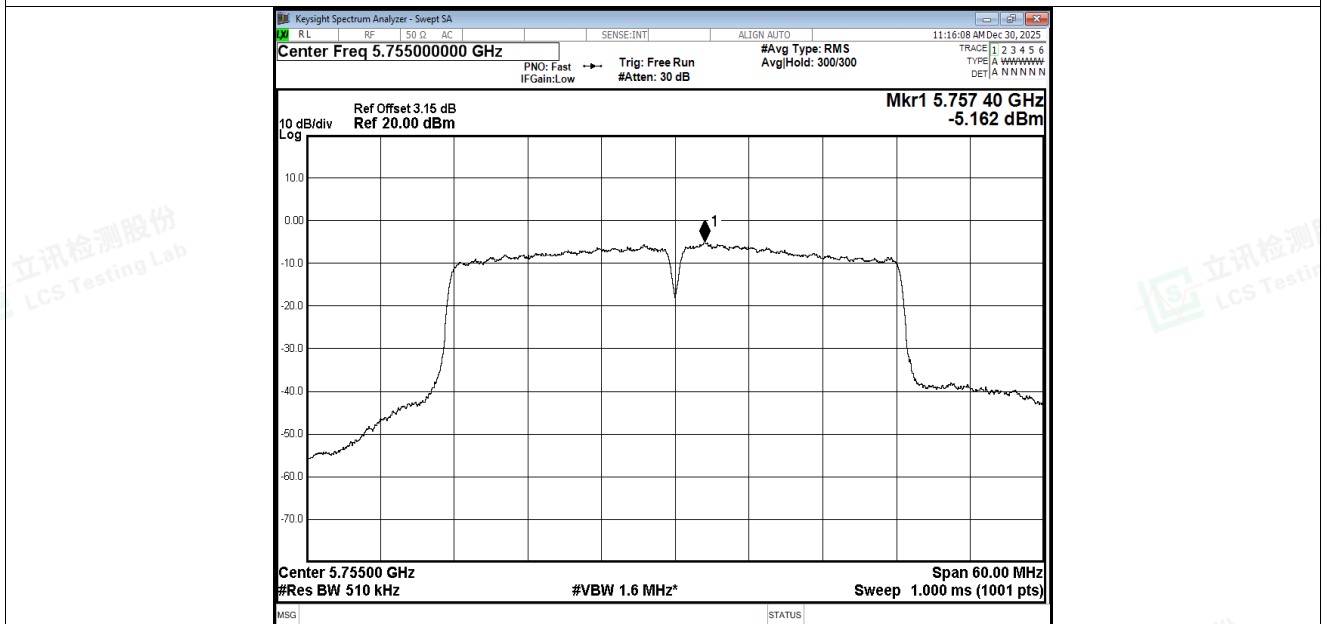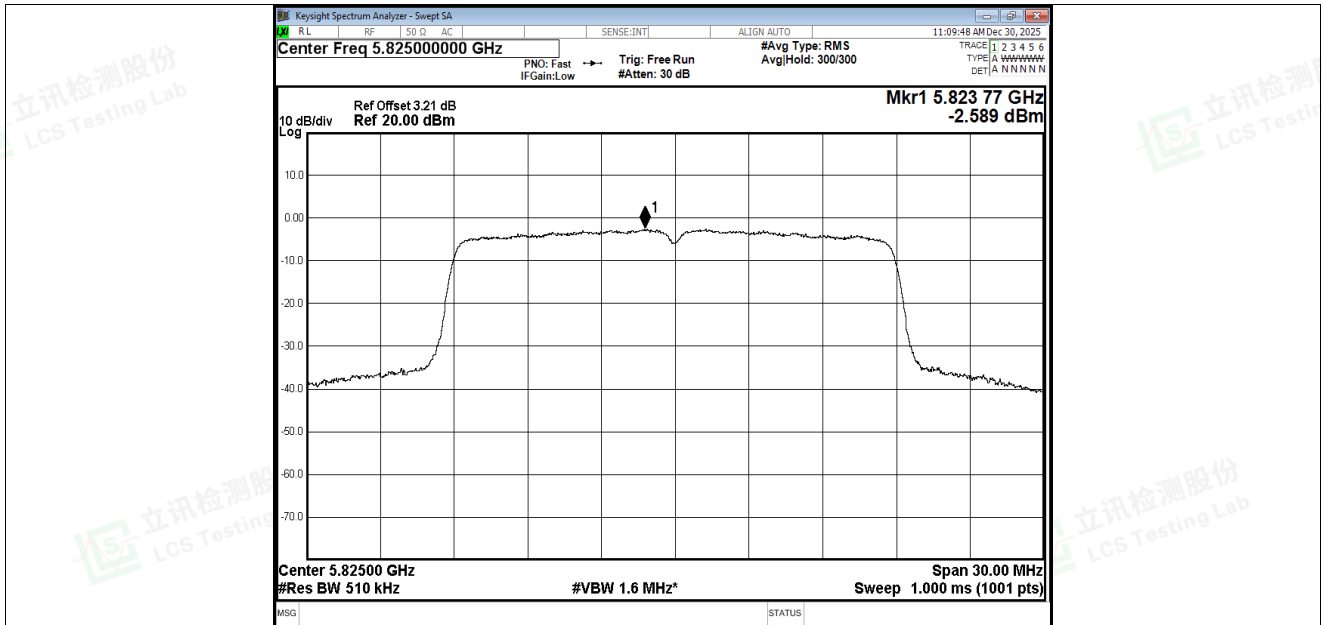


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

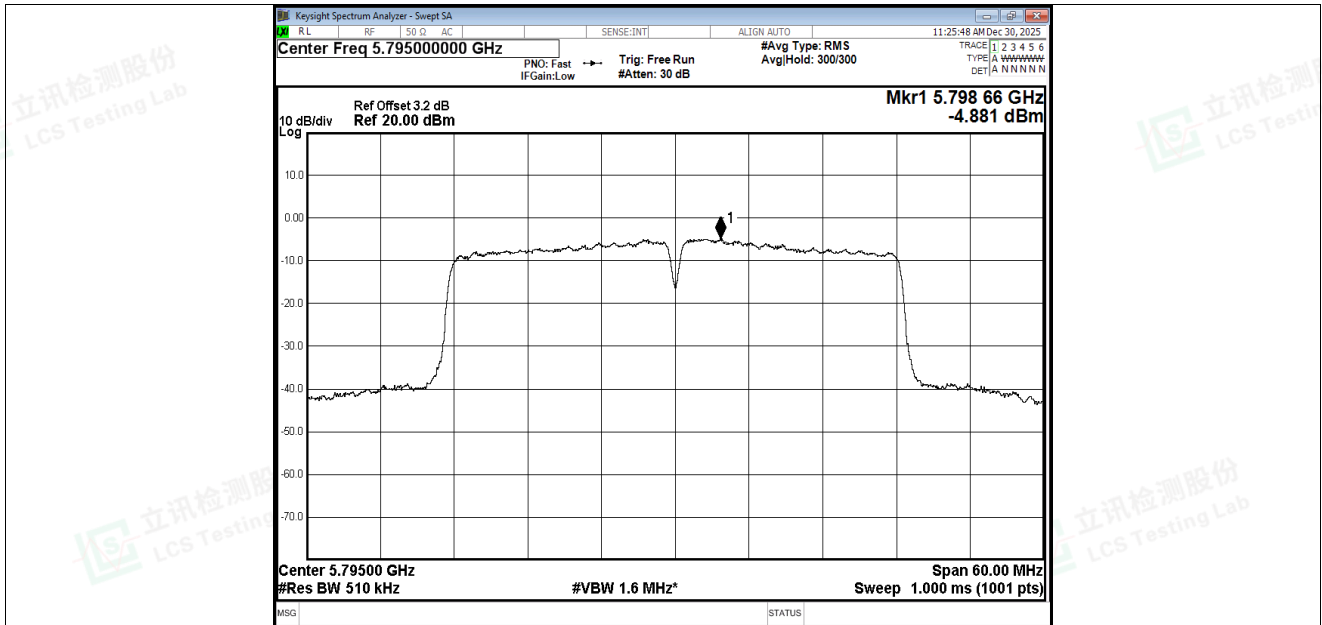

PSD NVNT ac40 5795MHz Ant3

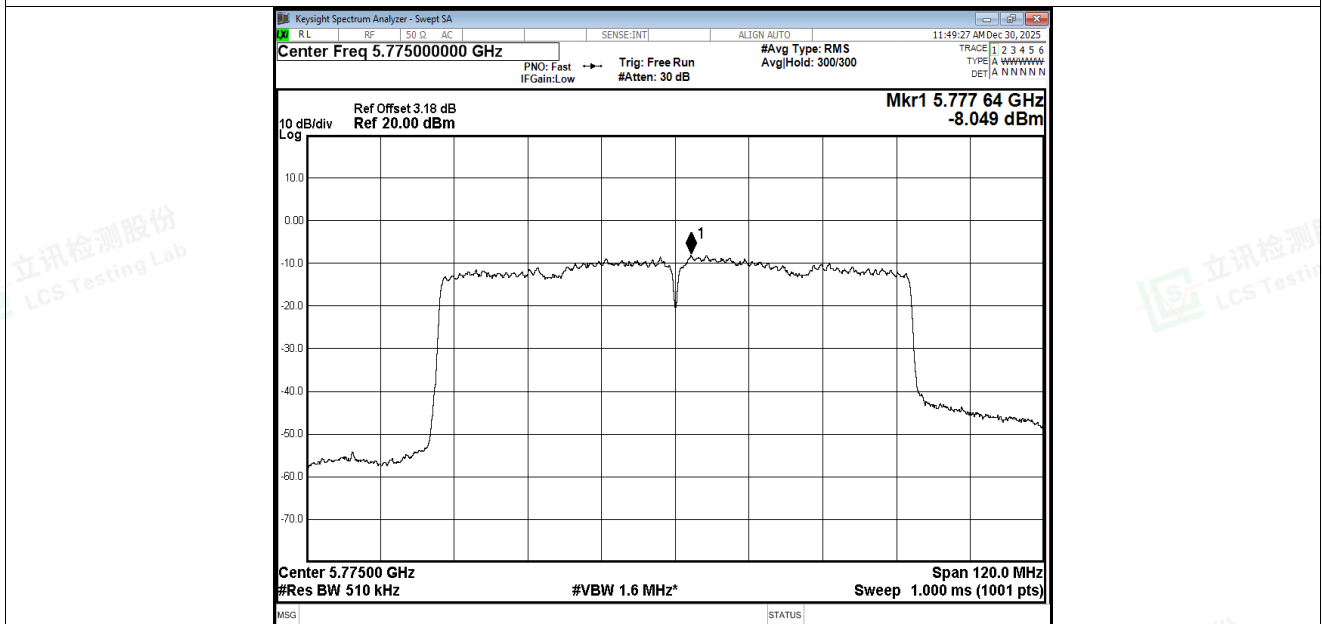

PSD NVNT ac80 5775MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

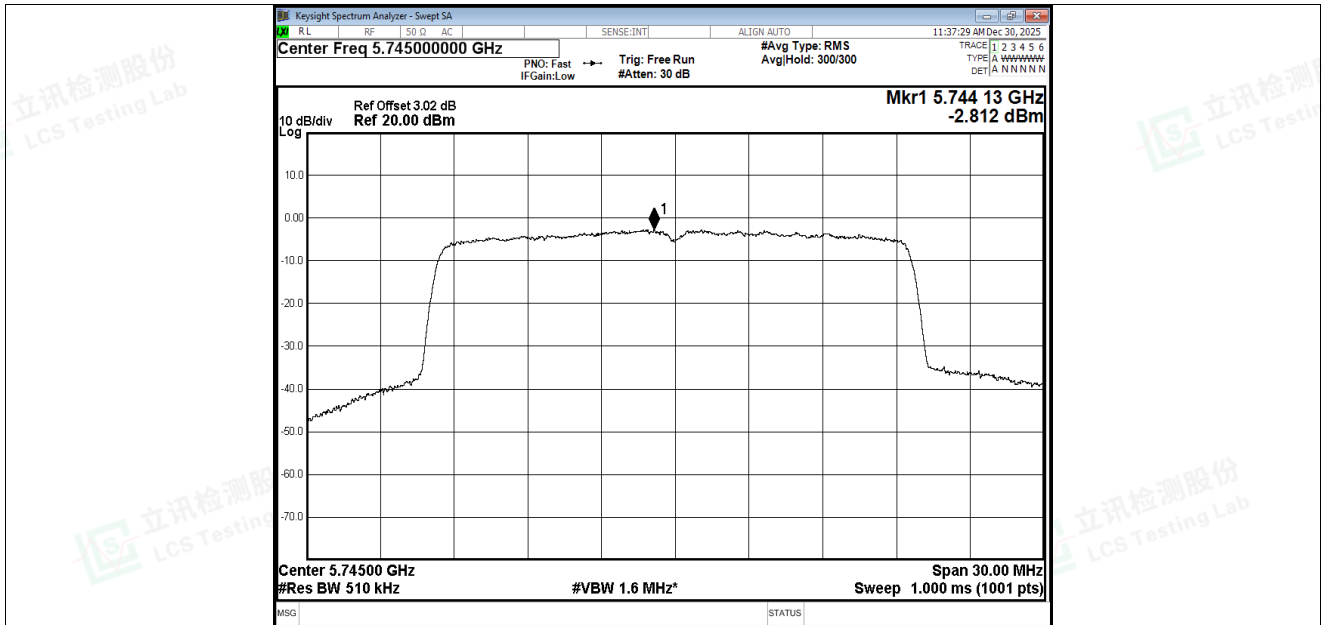

PSD NVNT ax20 5745MHz Ant3

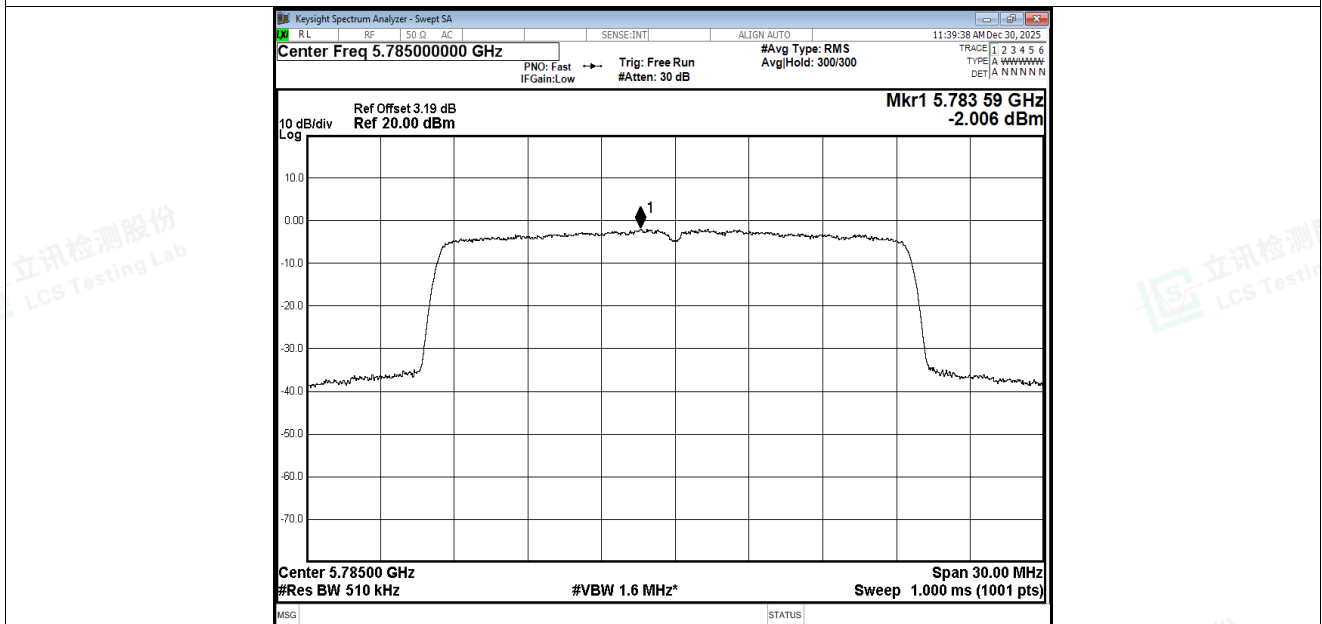

PSD NVNT ax20 5785MHz Ant3





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

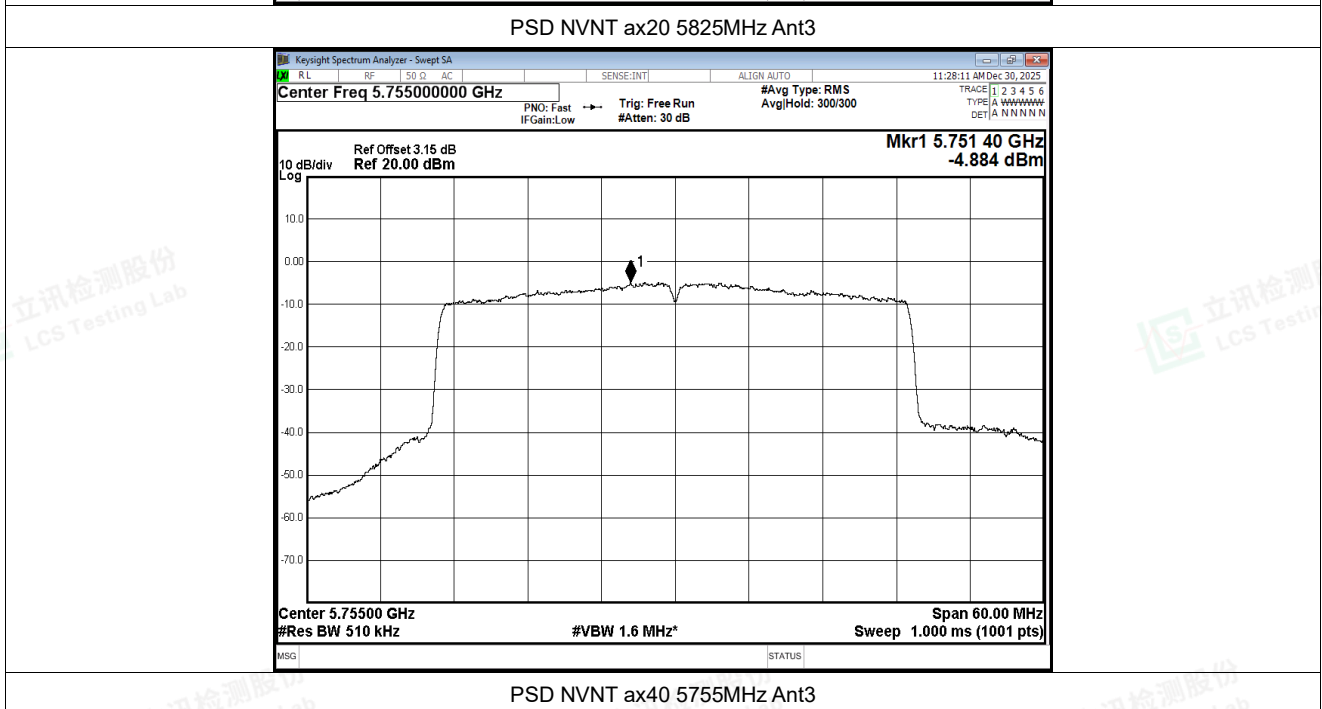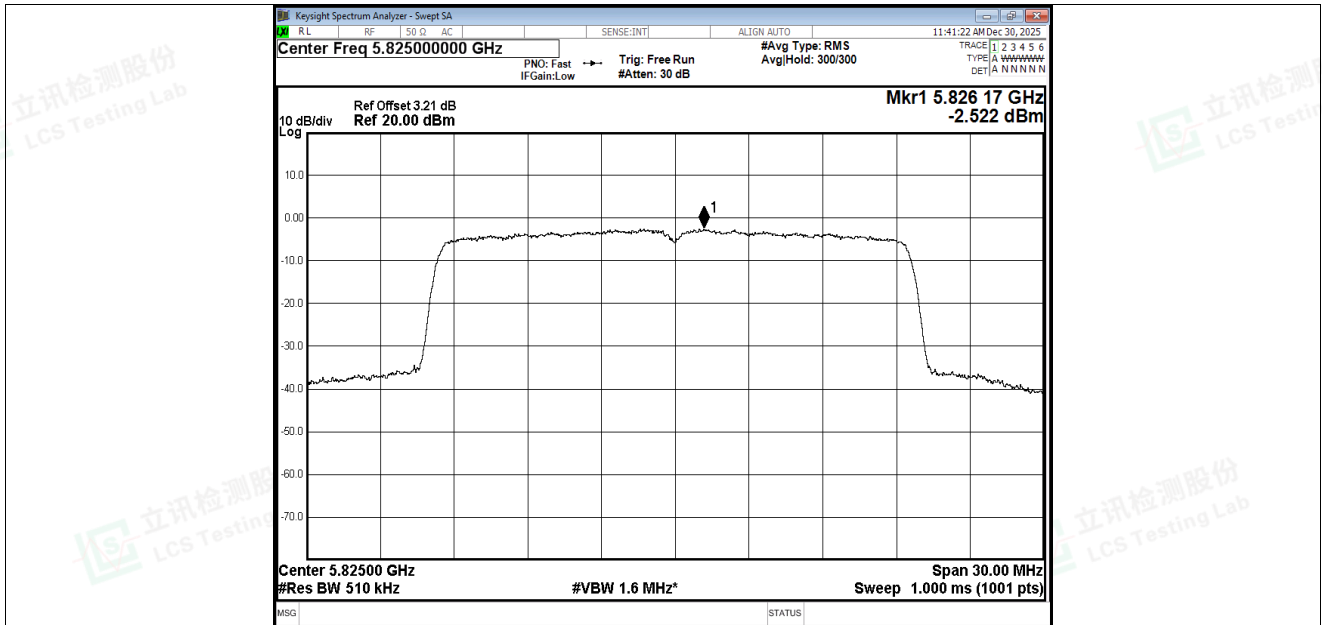


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

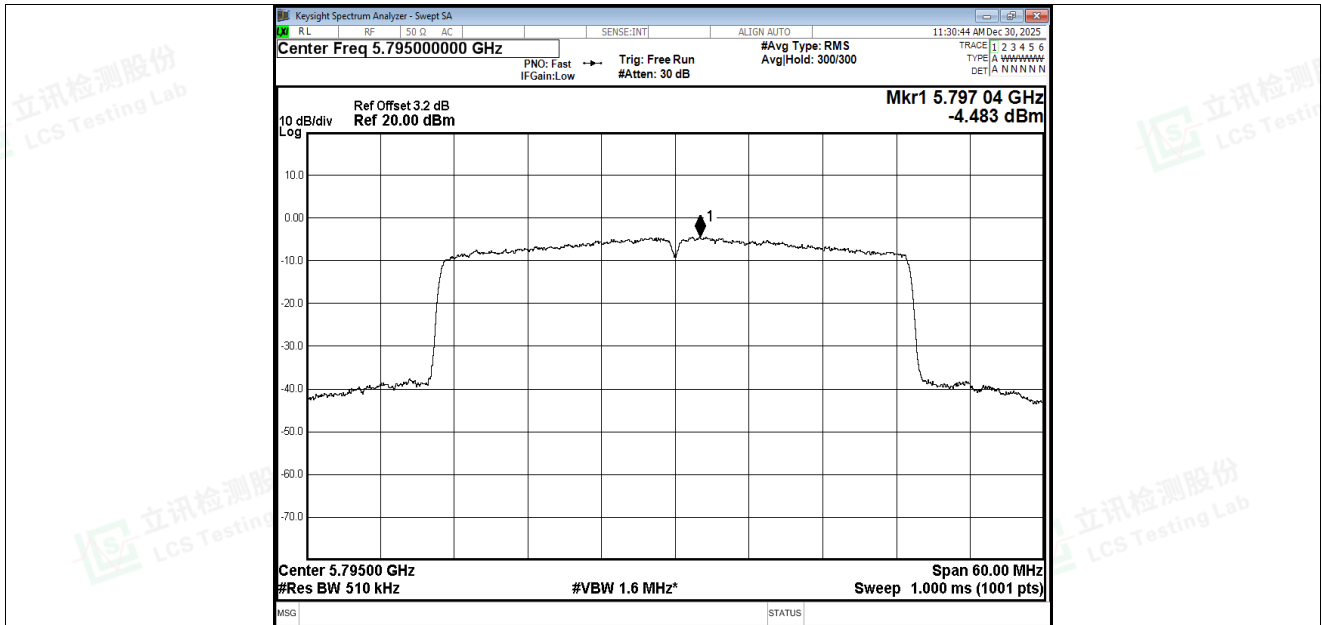

PSD NVNT ax40 5795MHz Ant3

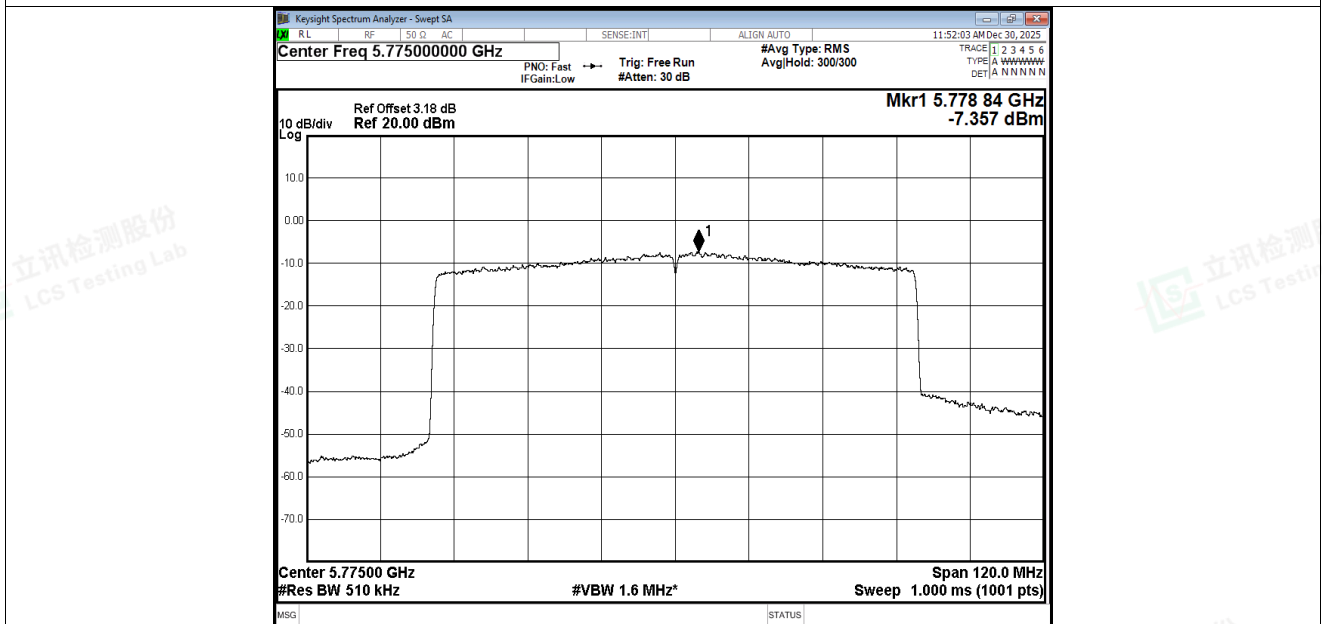

PSD NVNT ax80 5775MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

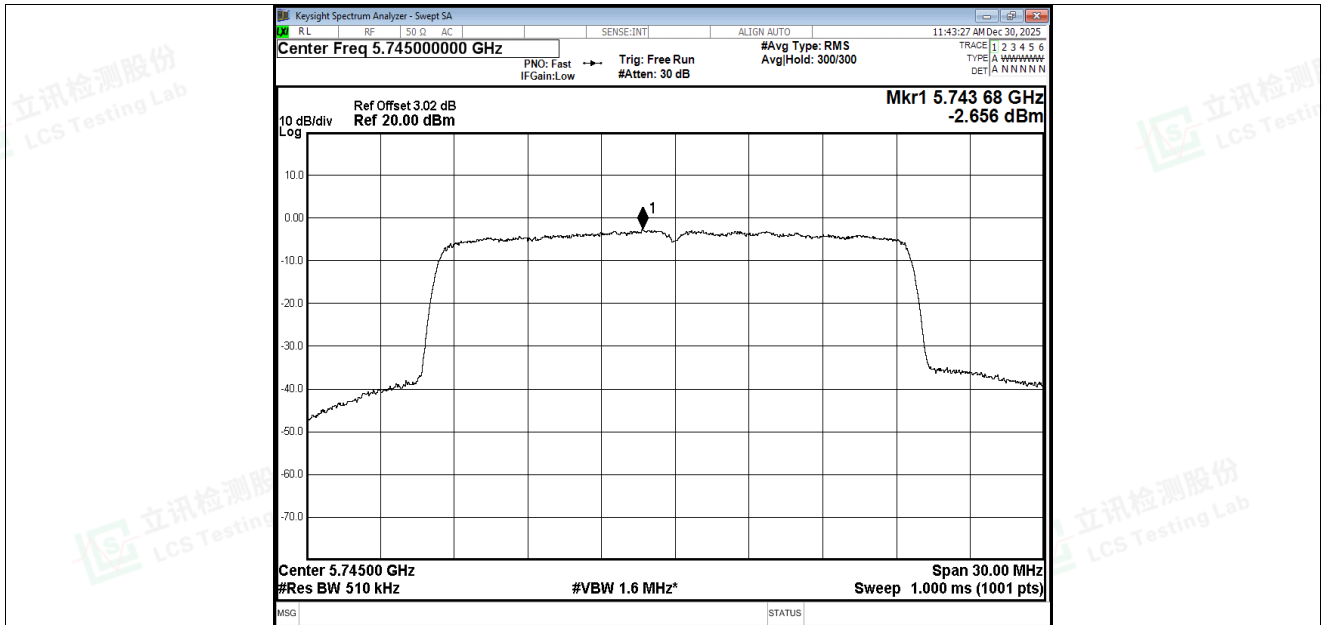

PSD NVNT be20 5745MHz Ant3

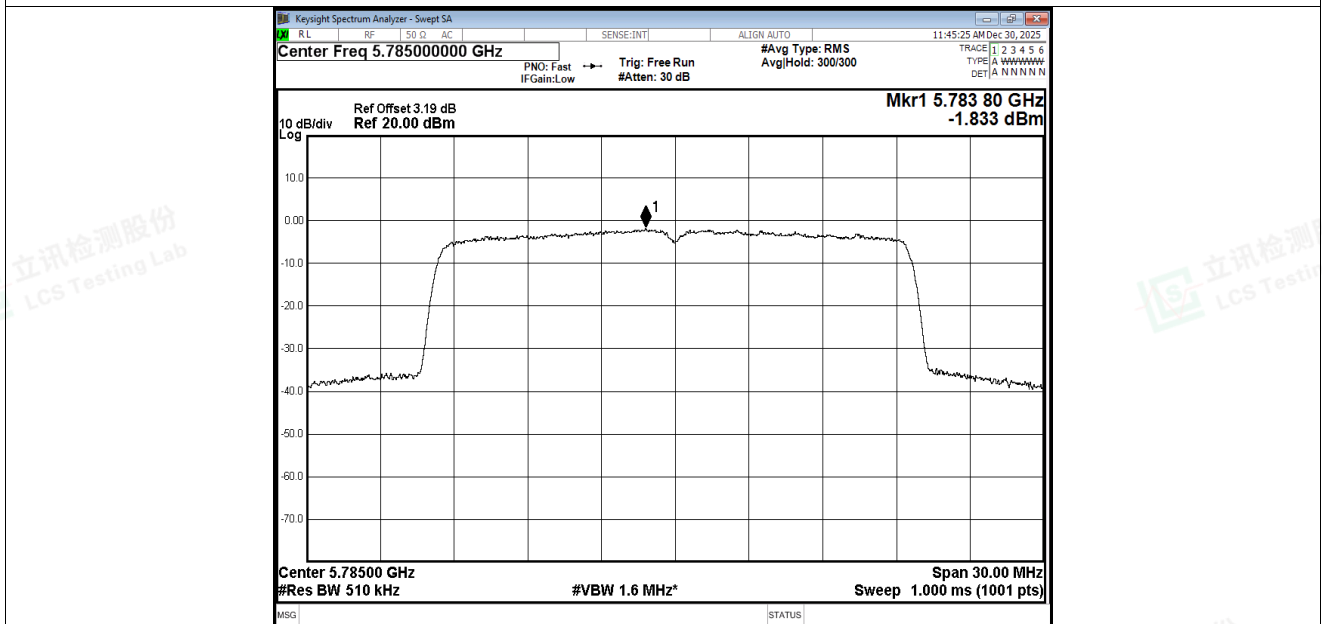

PSD NVNT be20 5785MHz Ant3




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

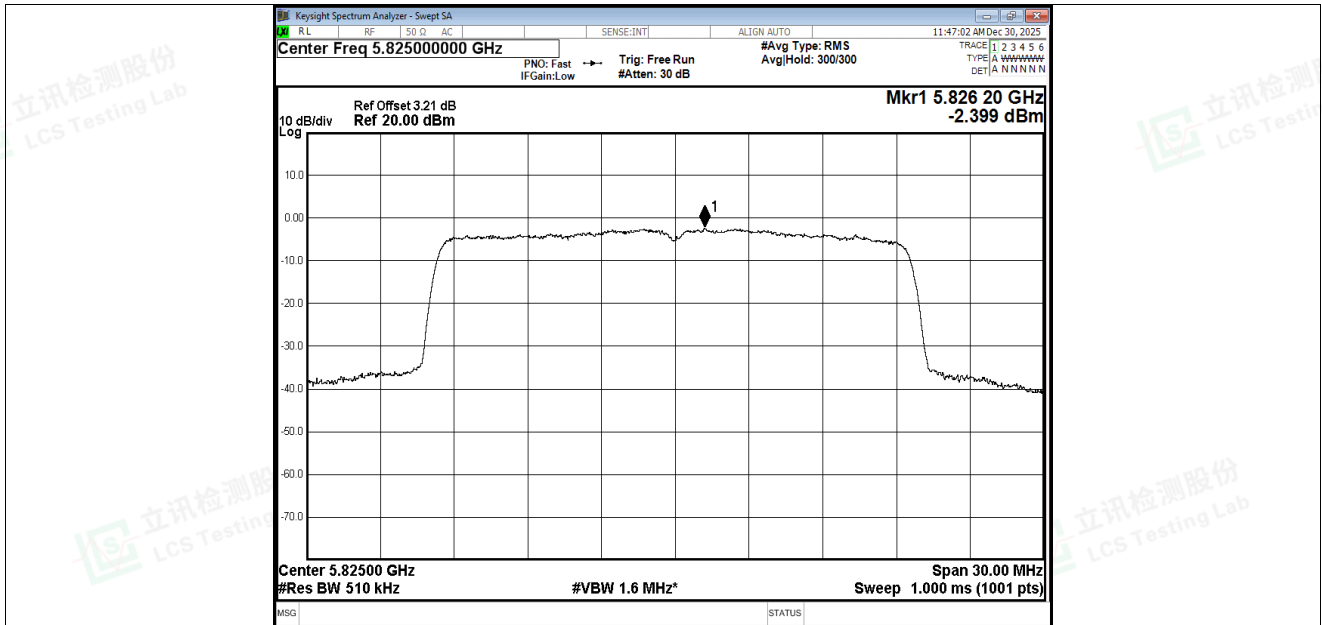

PSD NVNT be20 5825MHz Ant3

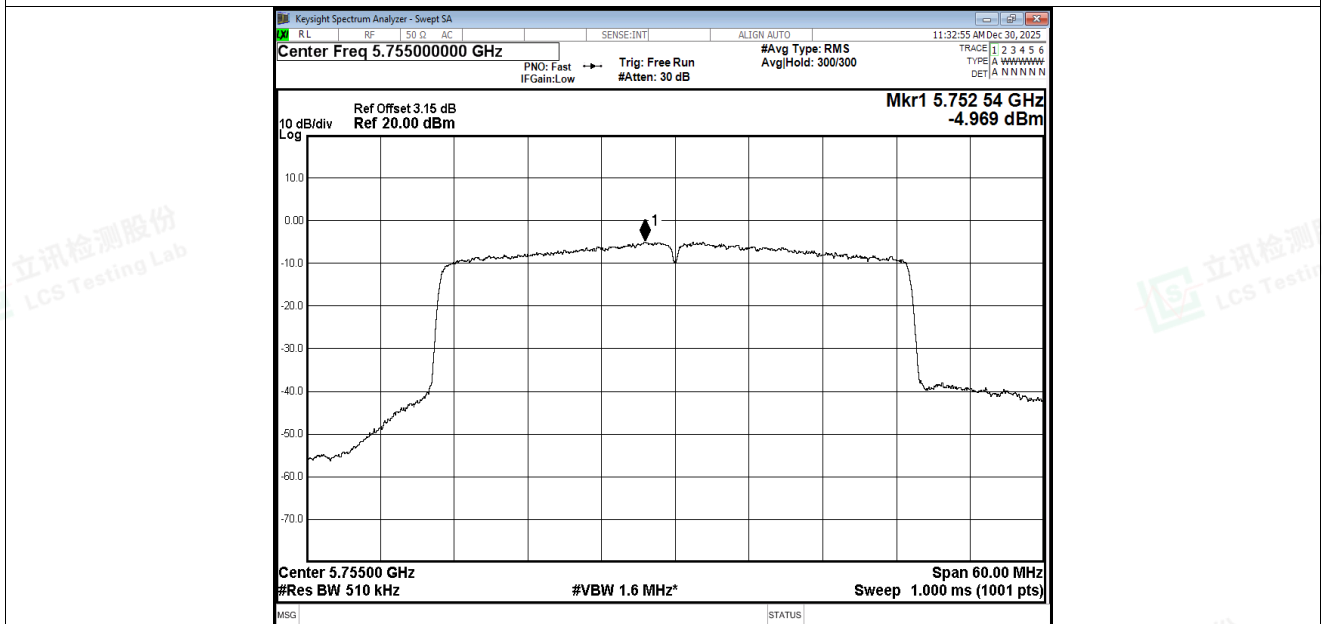

PSD NVNT be40 5755MHz Ant3





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

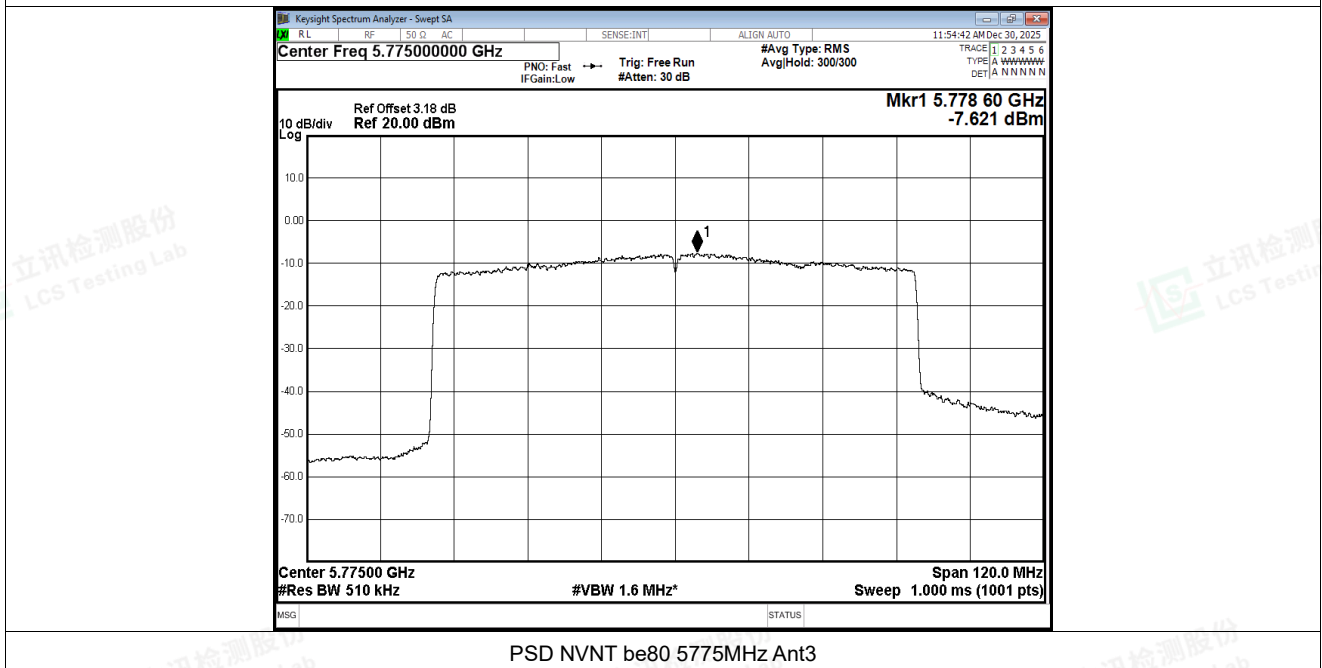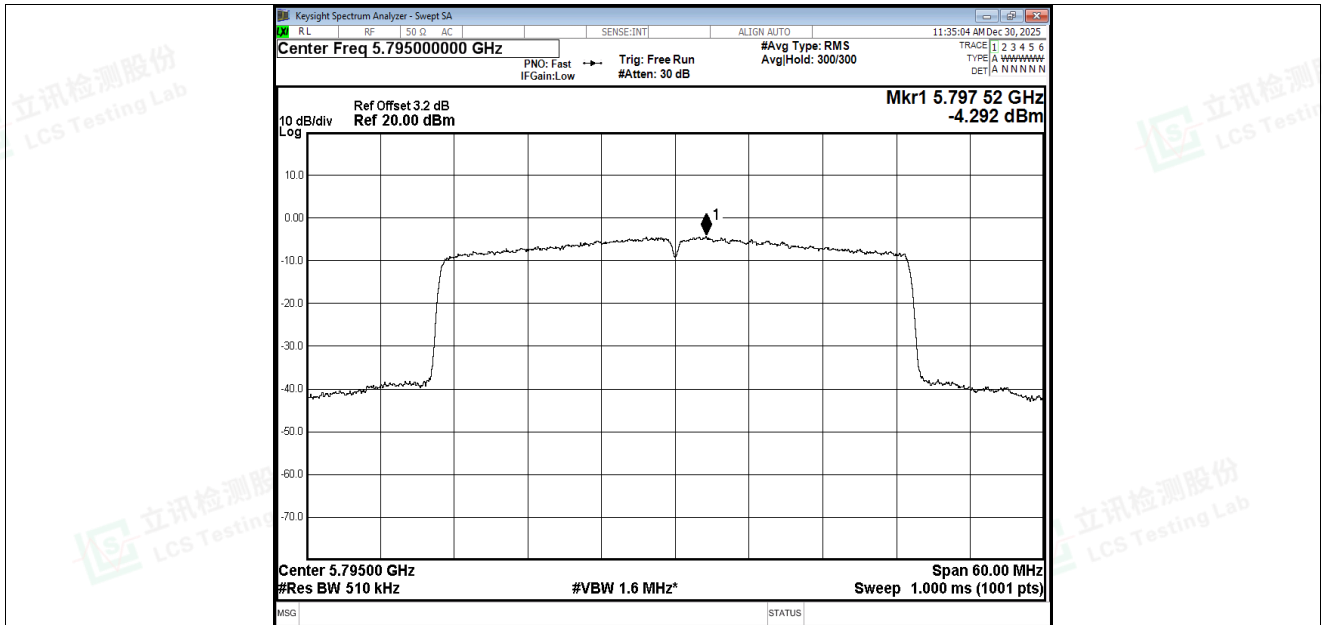


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

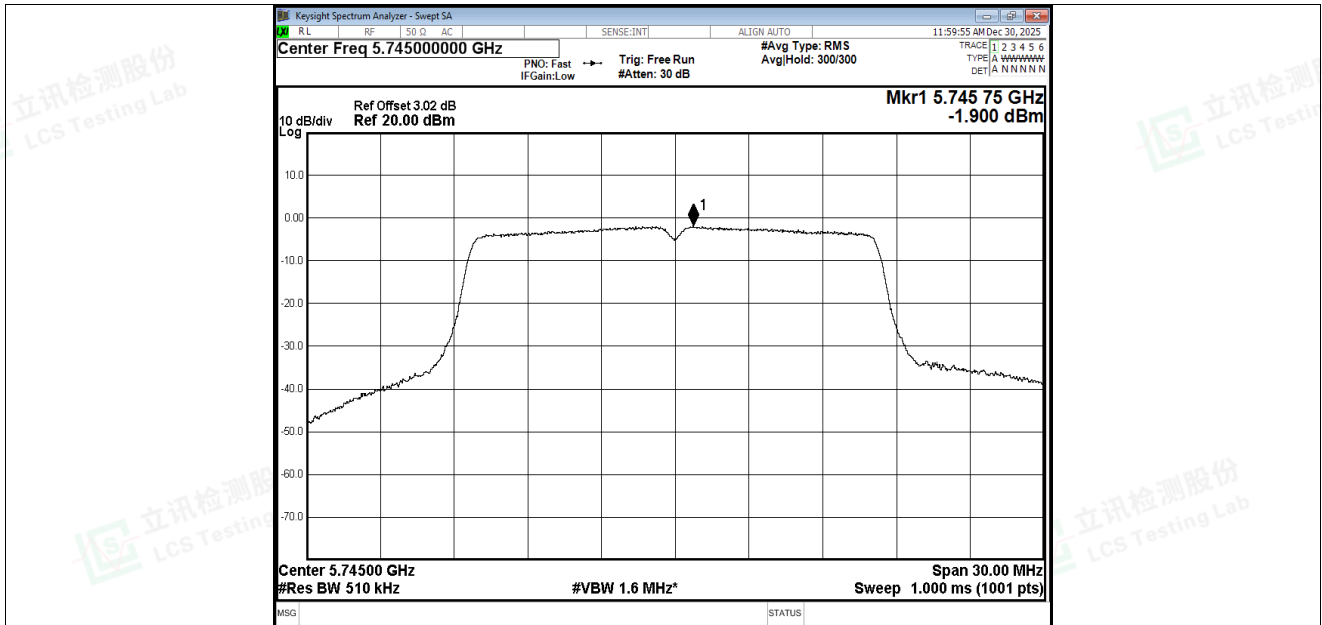

PSD NVNT a 5745MHz Ant4

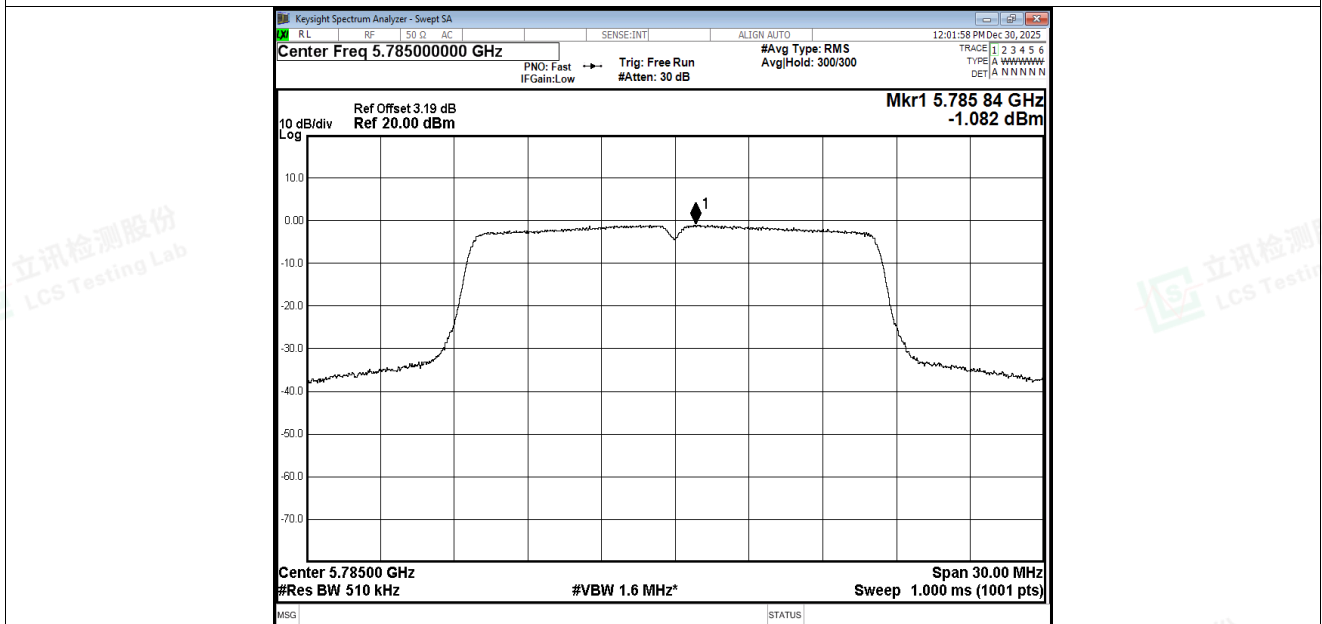

PSD NVNT a 5785MHz Ant4




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

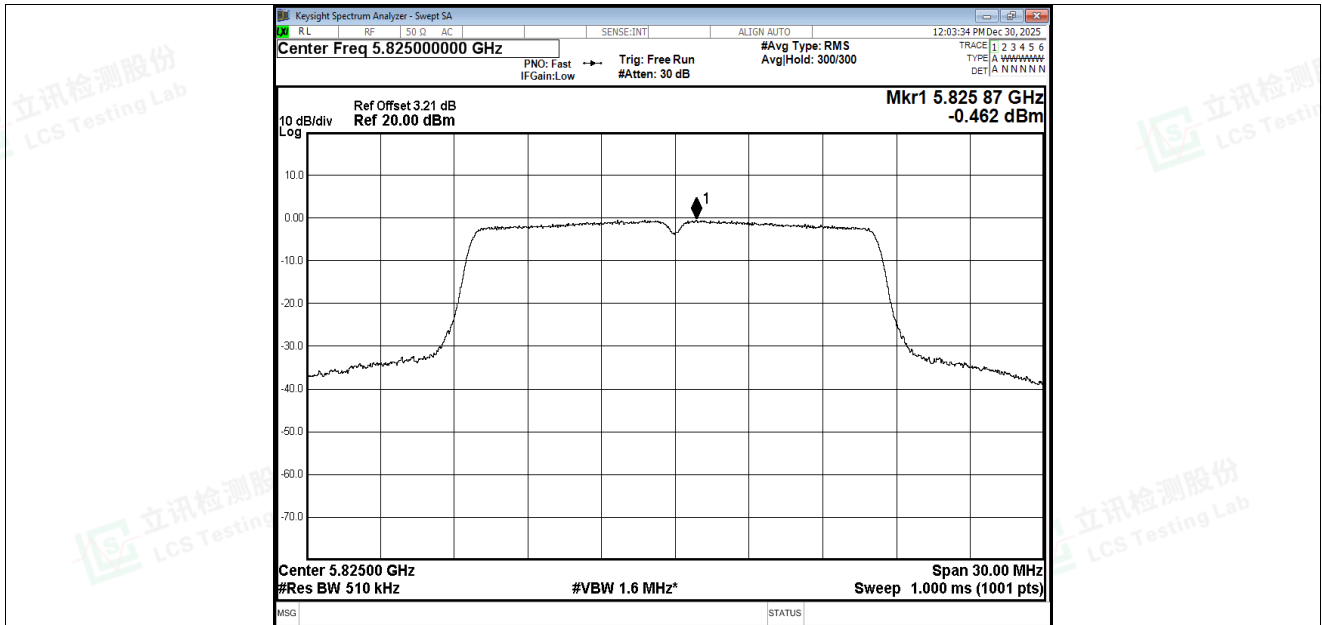

PSD NVNT a 5825MHz Ant4

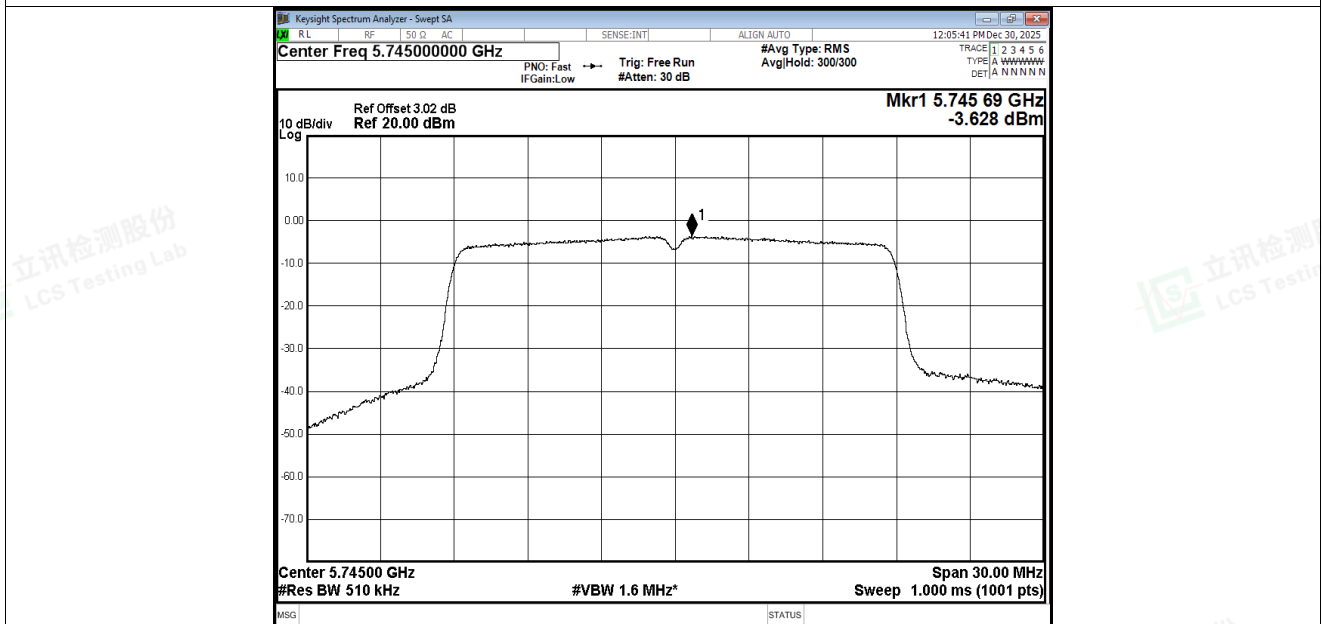

PSD NVNT n20 5745MHz Ant4




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

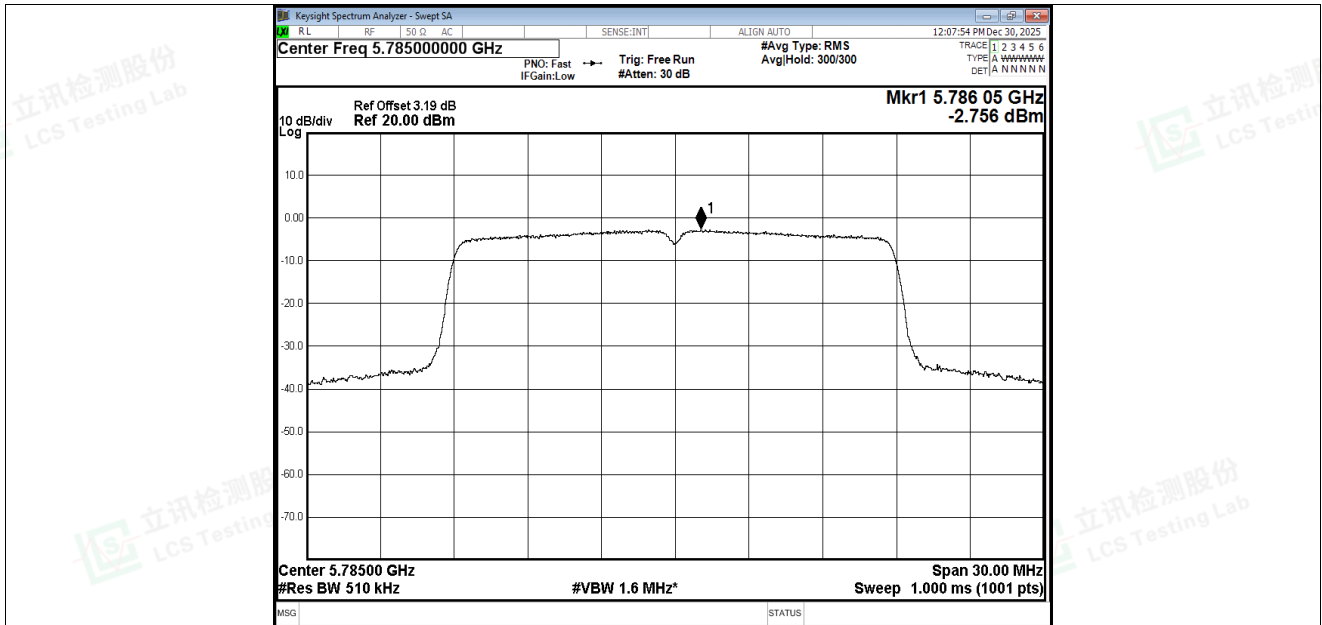

PSD NVNT n20 5785MHz Ant4

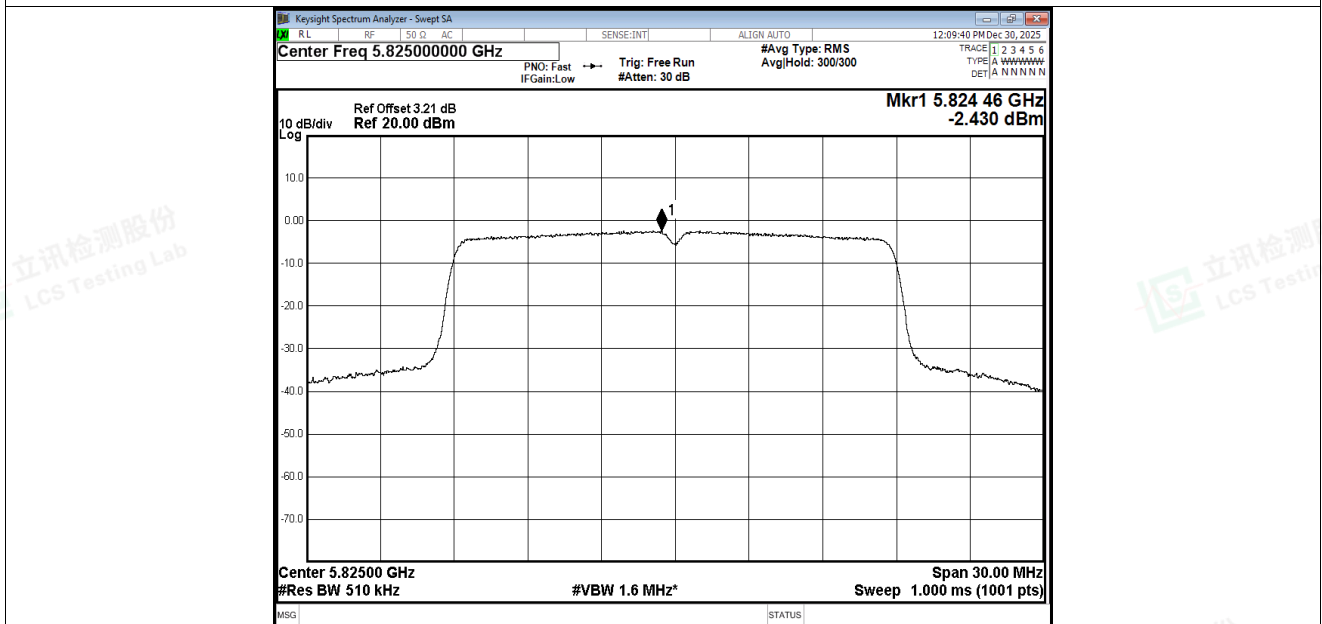

PSD NVNT n20 5825MHz Ant4





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

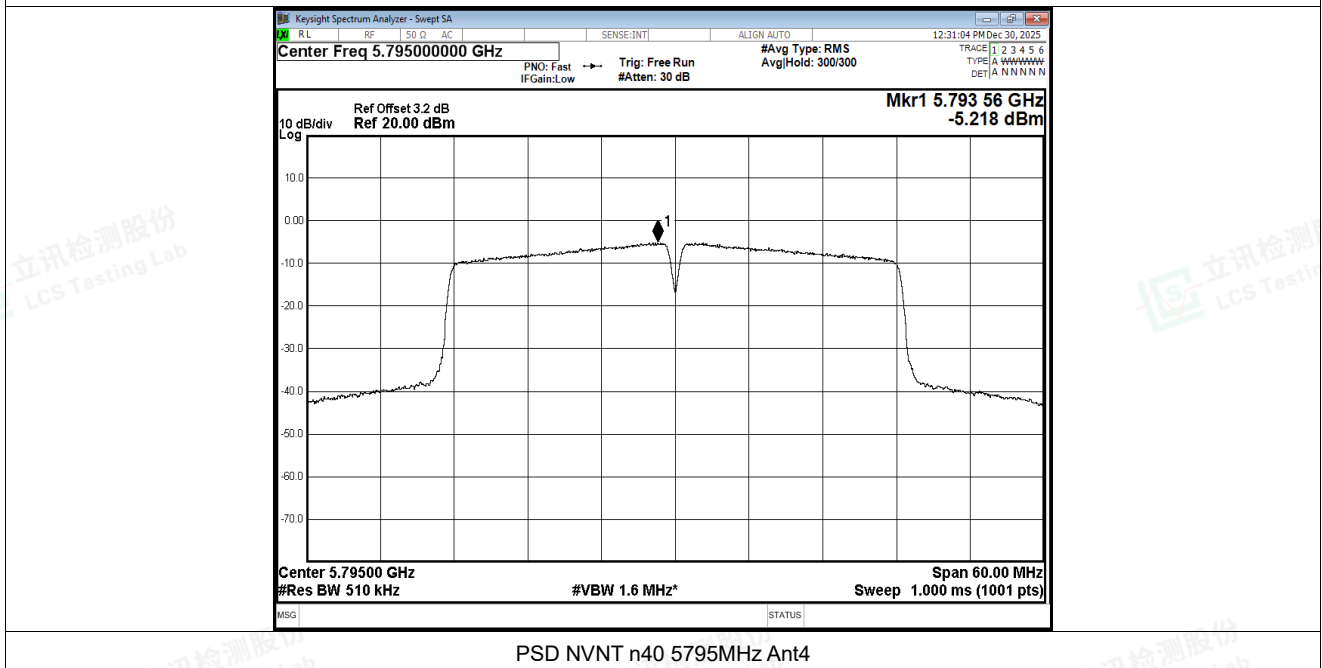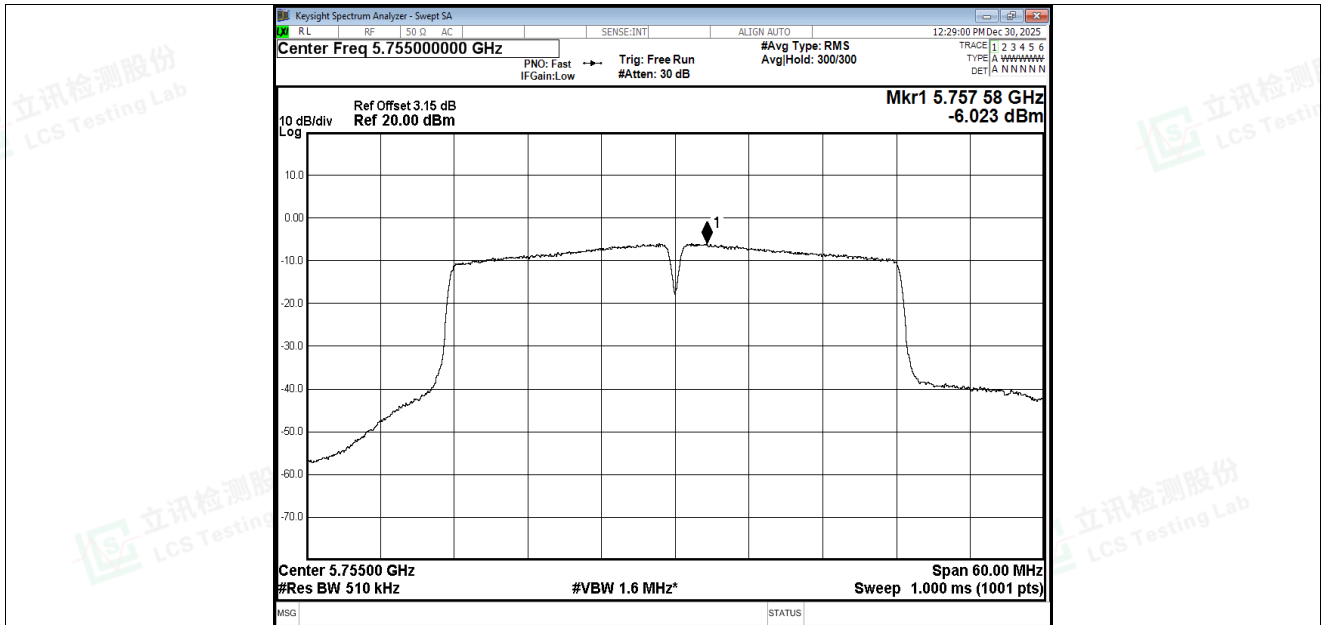


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

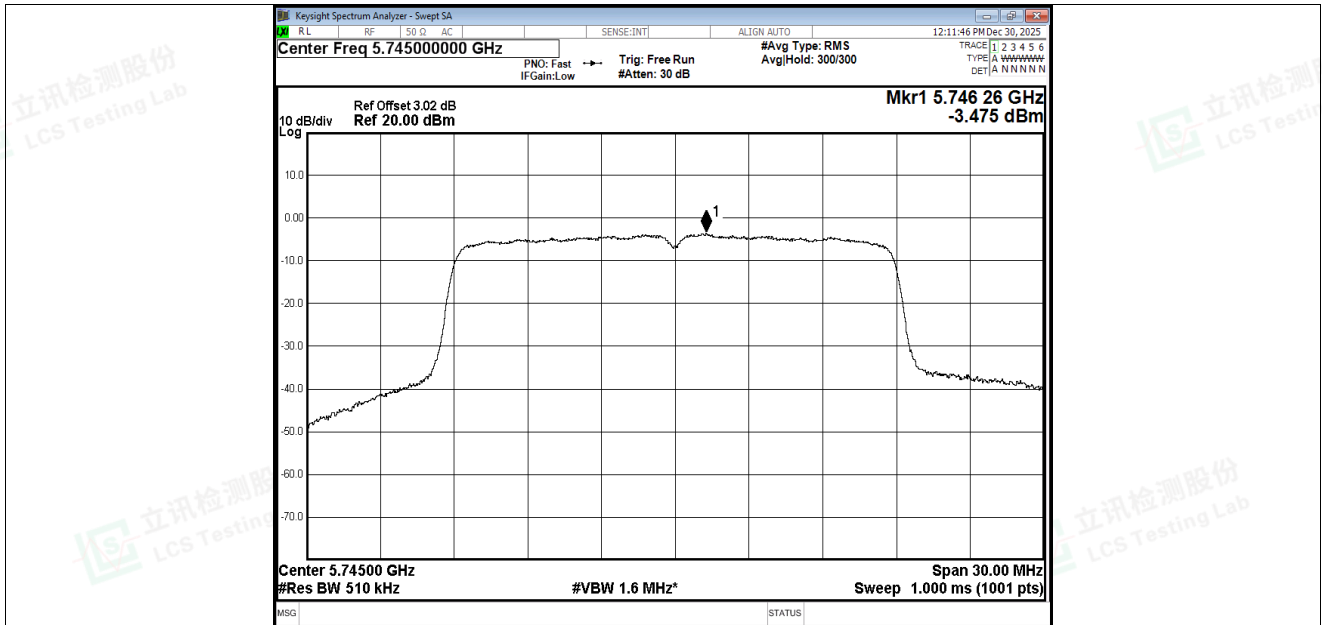

PSD NVNT ac20 5745MHz Ant4

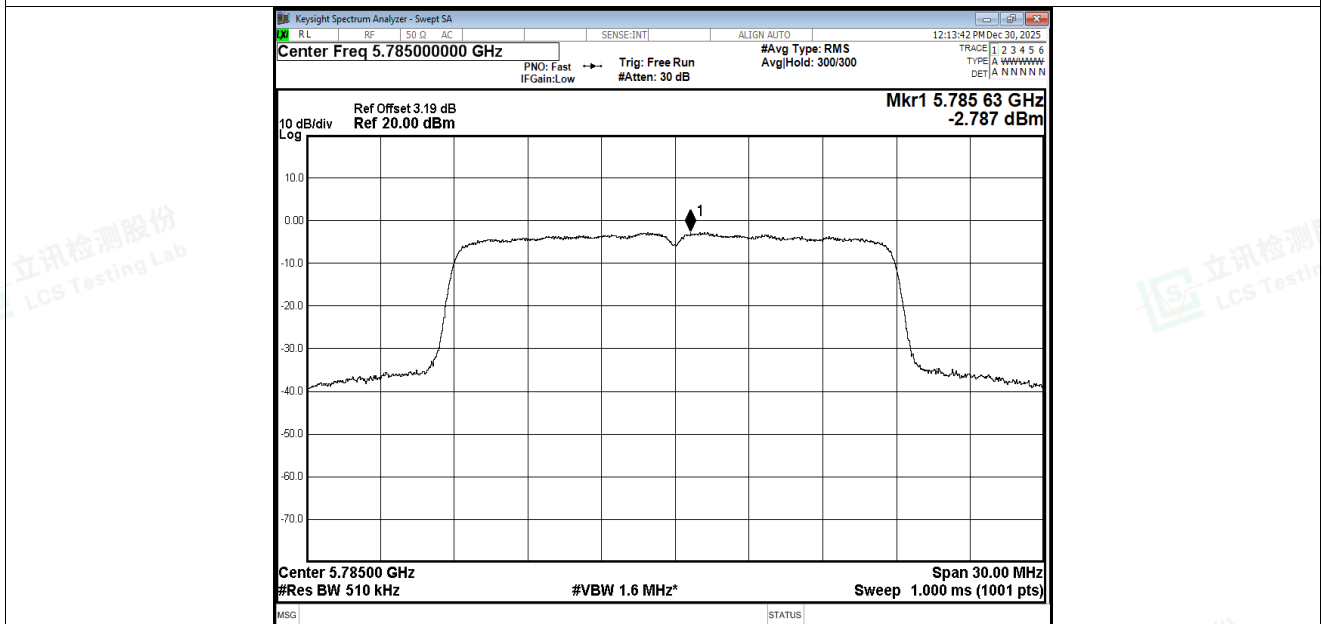

PSD NVNT ac20 5785MHz Ant4




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

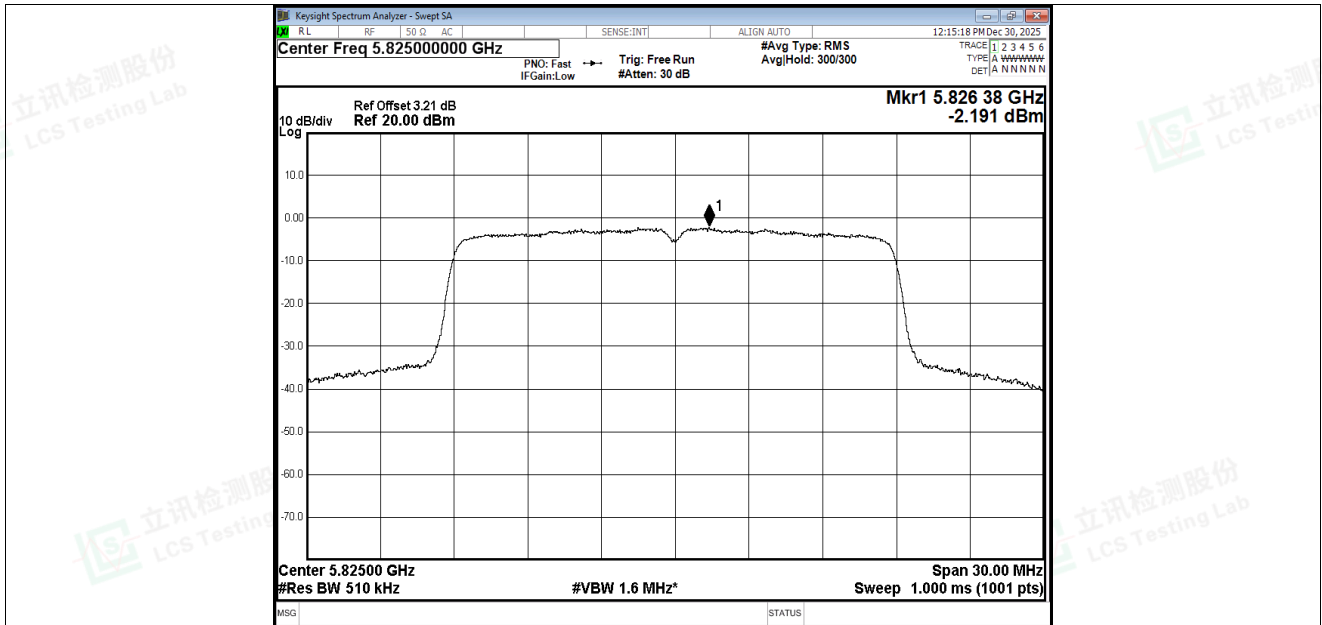

PSD NVNT ac20 5825MHz Ant4

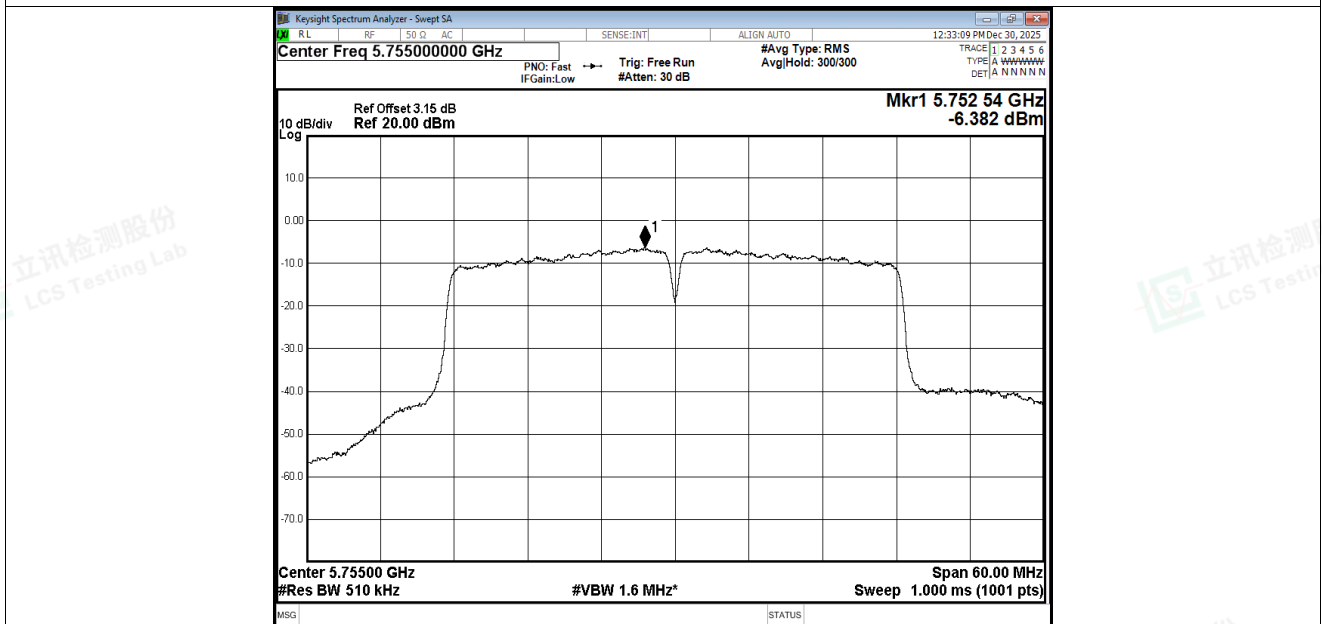

PSD NVNT ac40 5755MHz Ant4





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

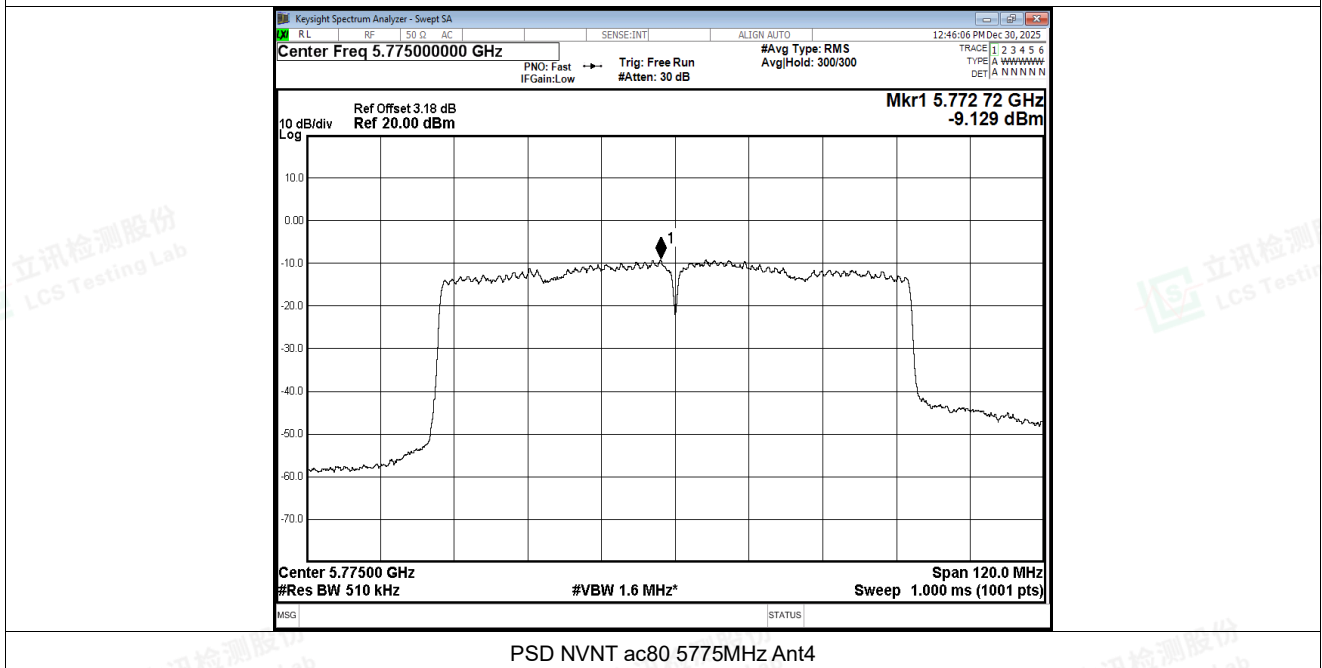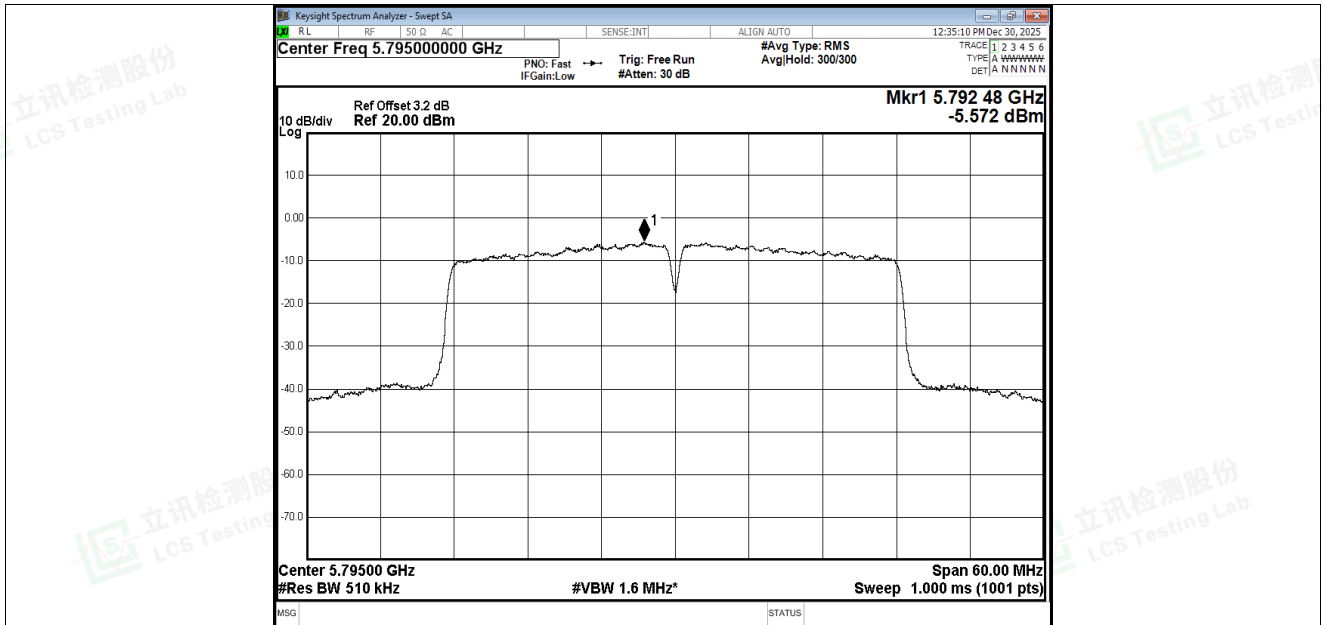


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

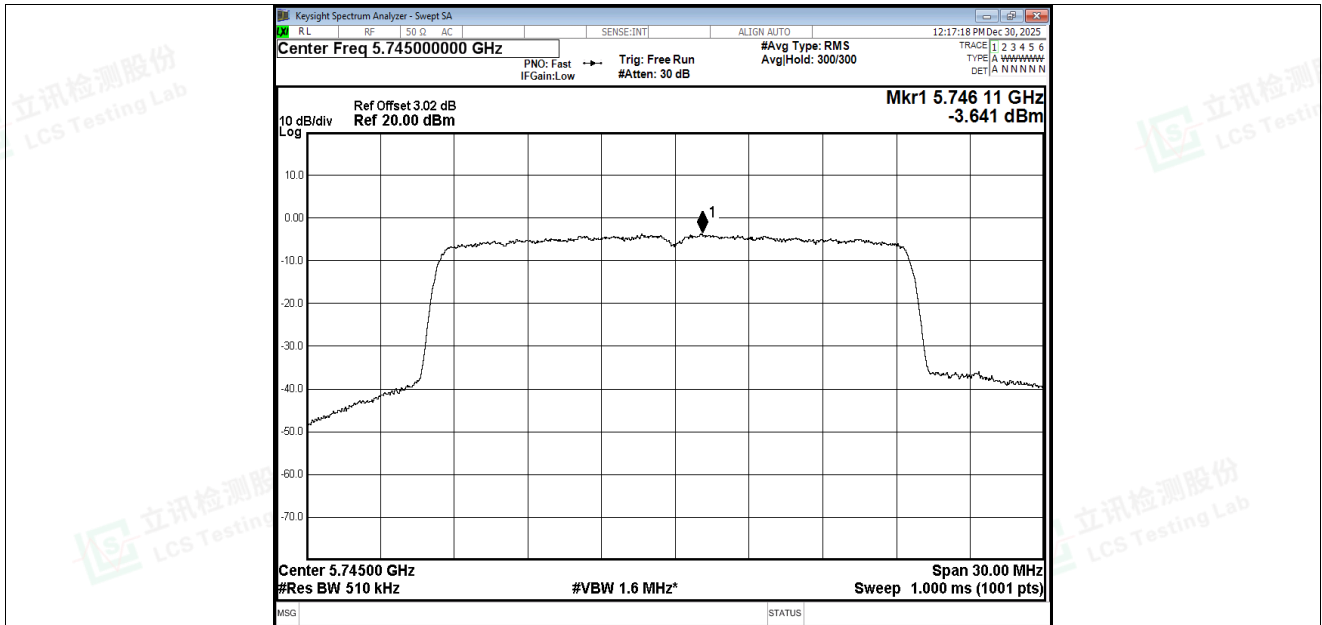

PSD NVNT ax20 5745MHz Ant4

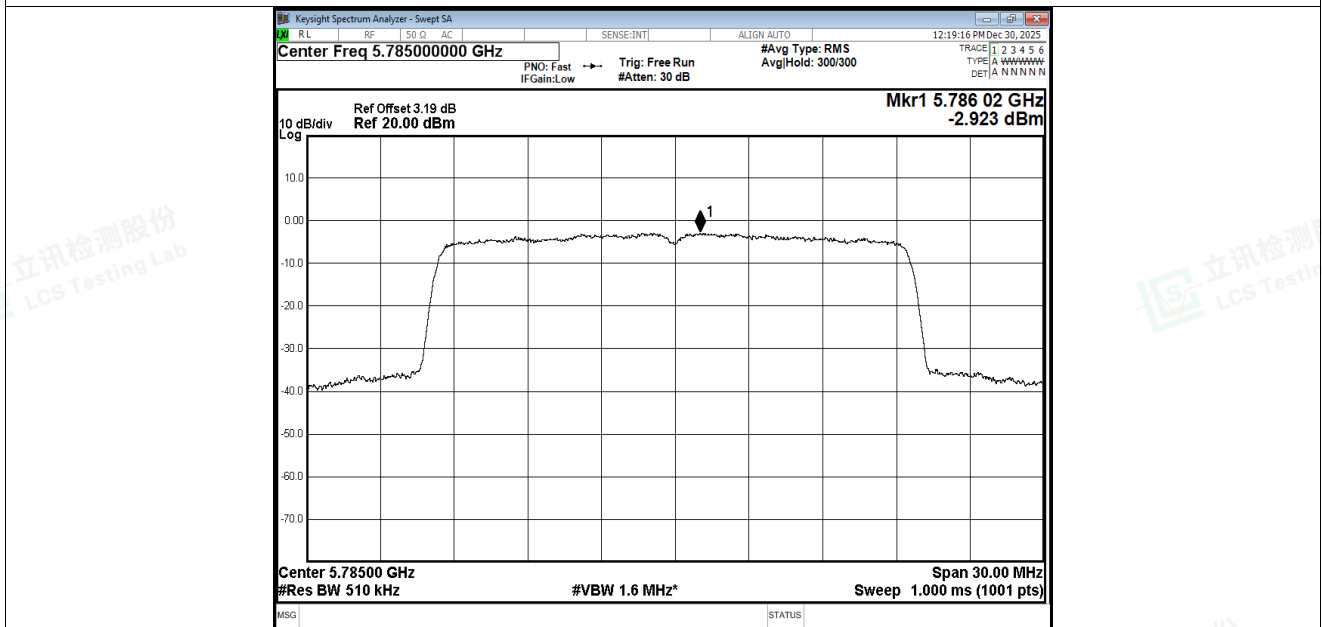

PSD NVNT ax20 5785MHz Ant4





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

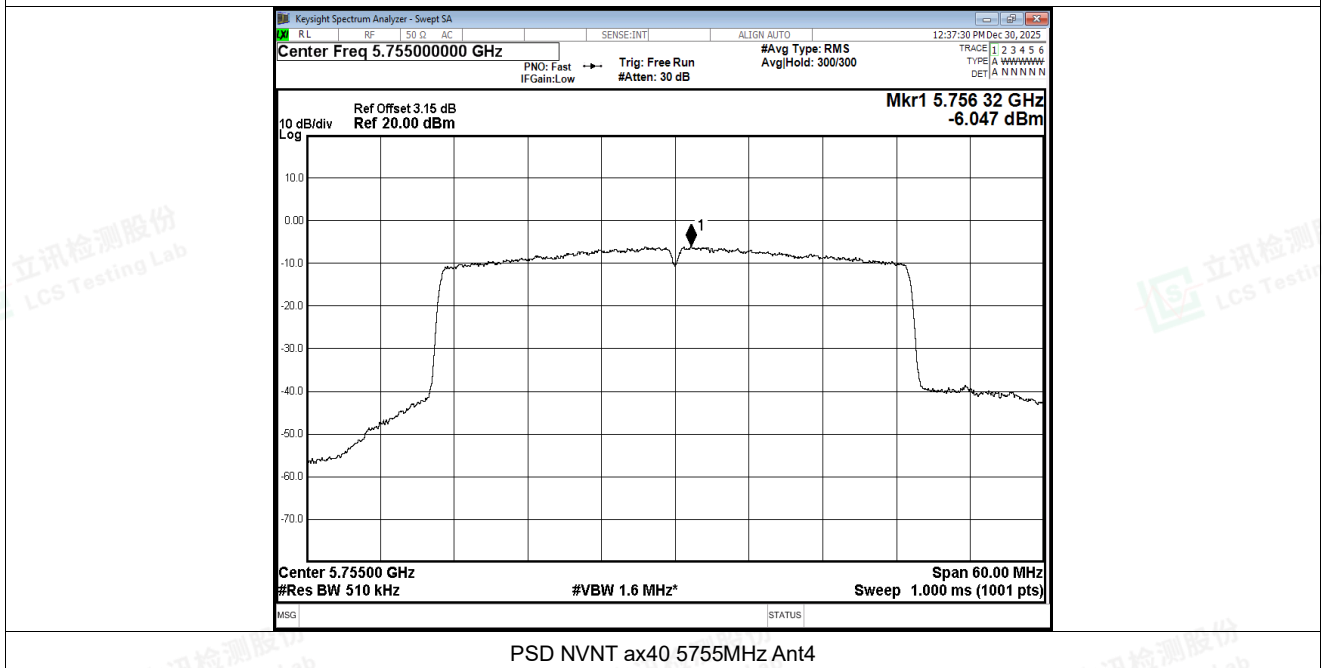
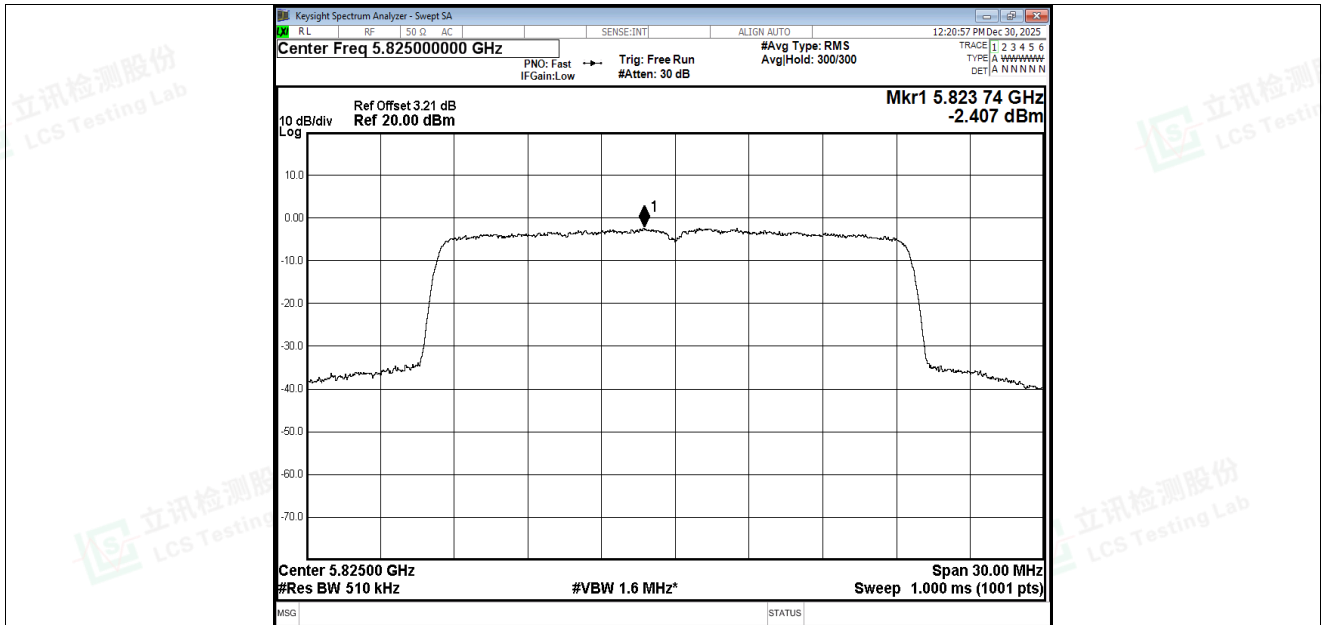


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

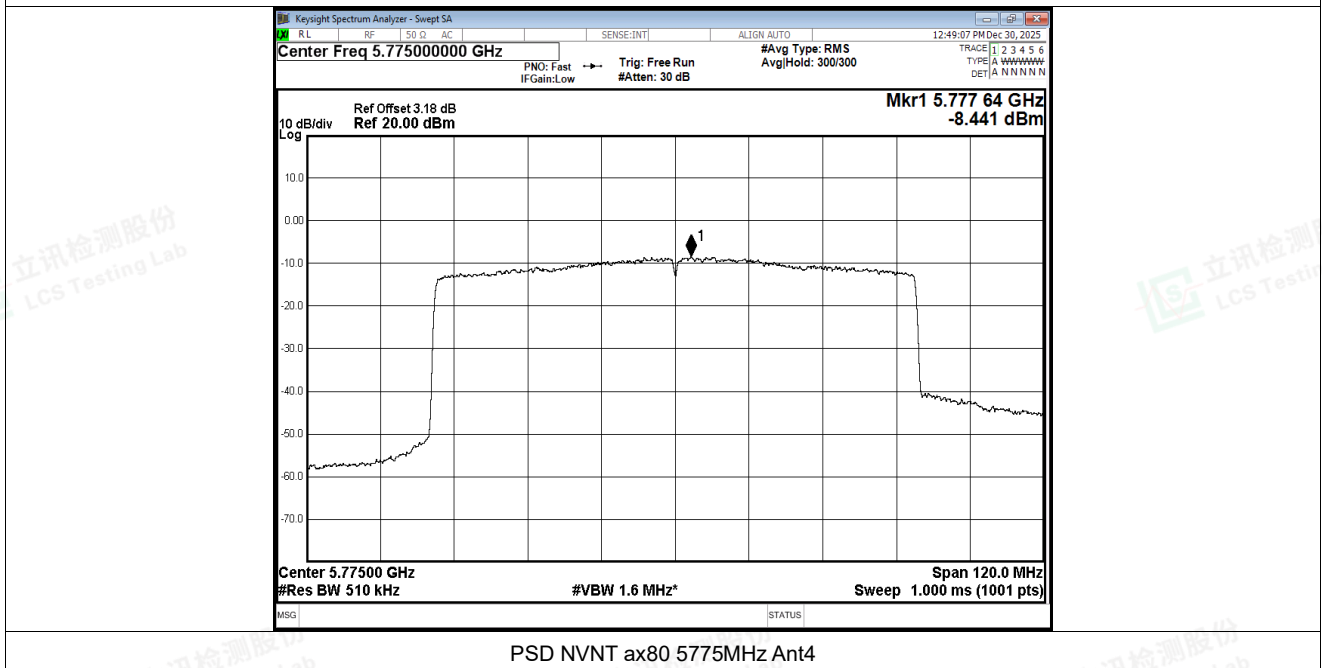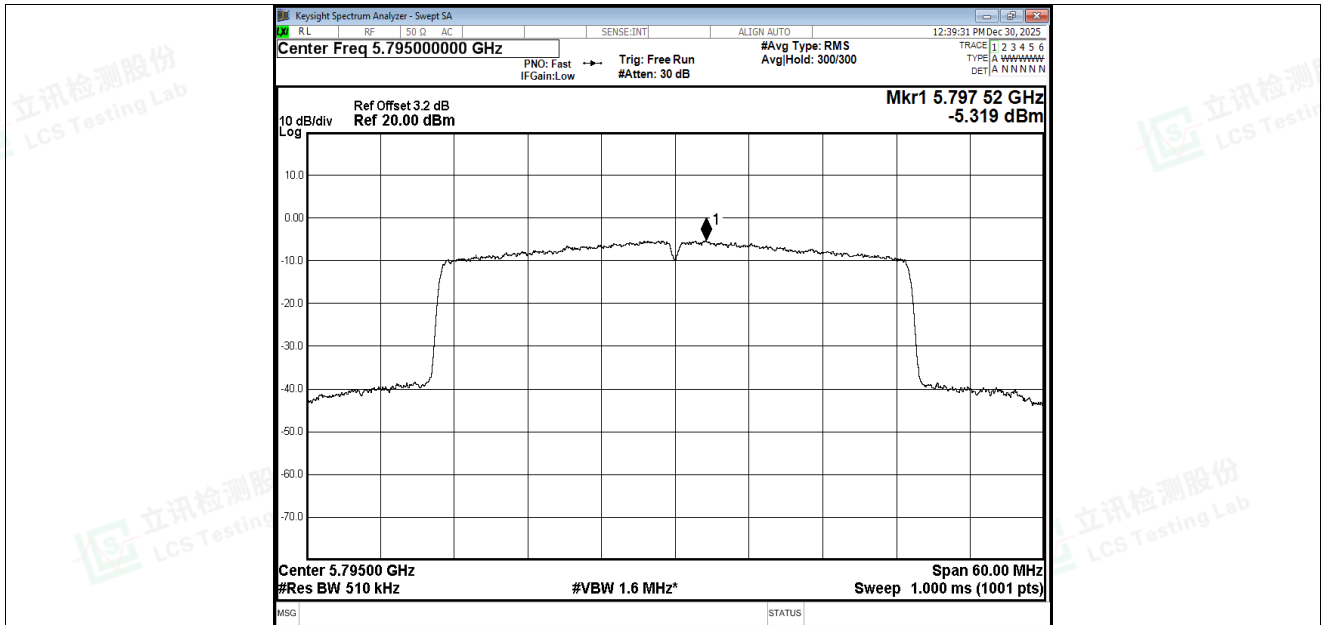


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

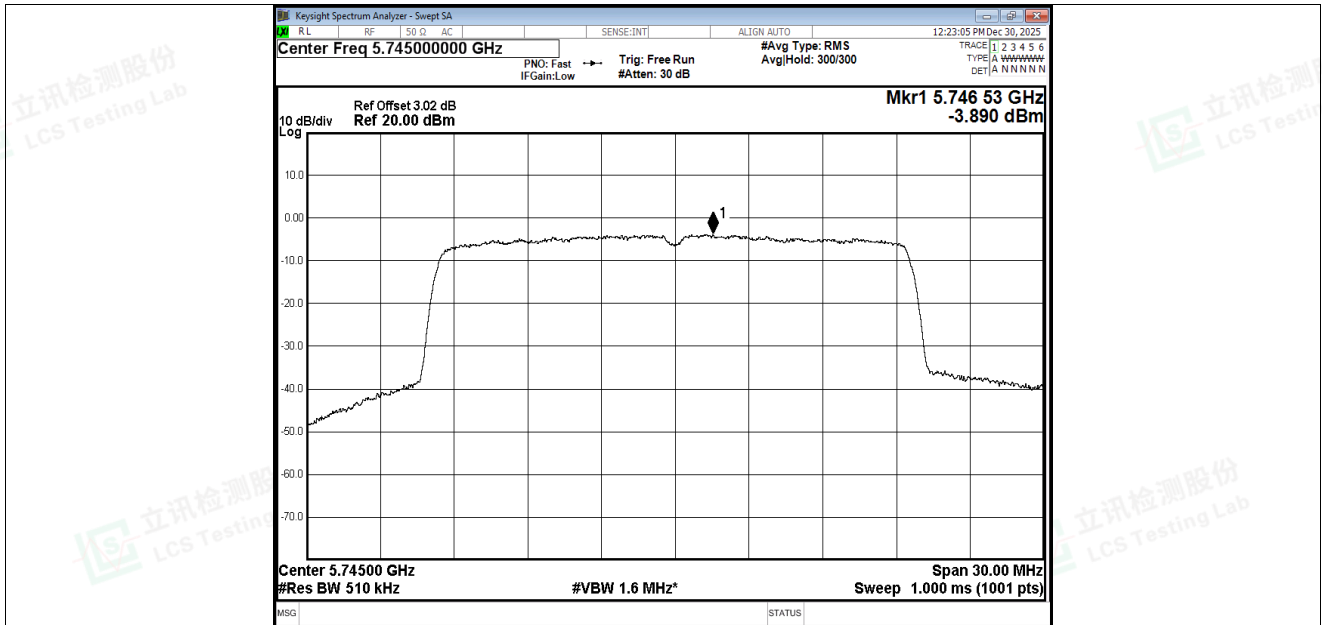

PSD NVNT be20 5745MHz Ant4

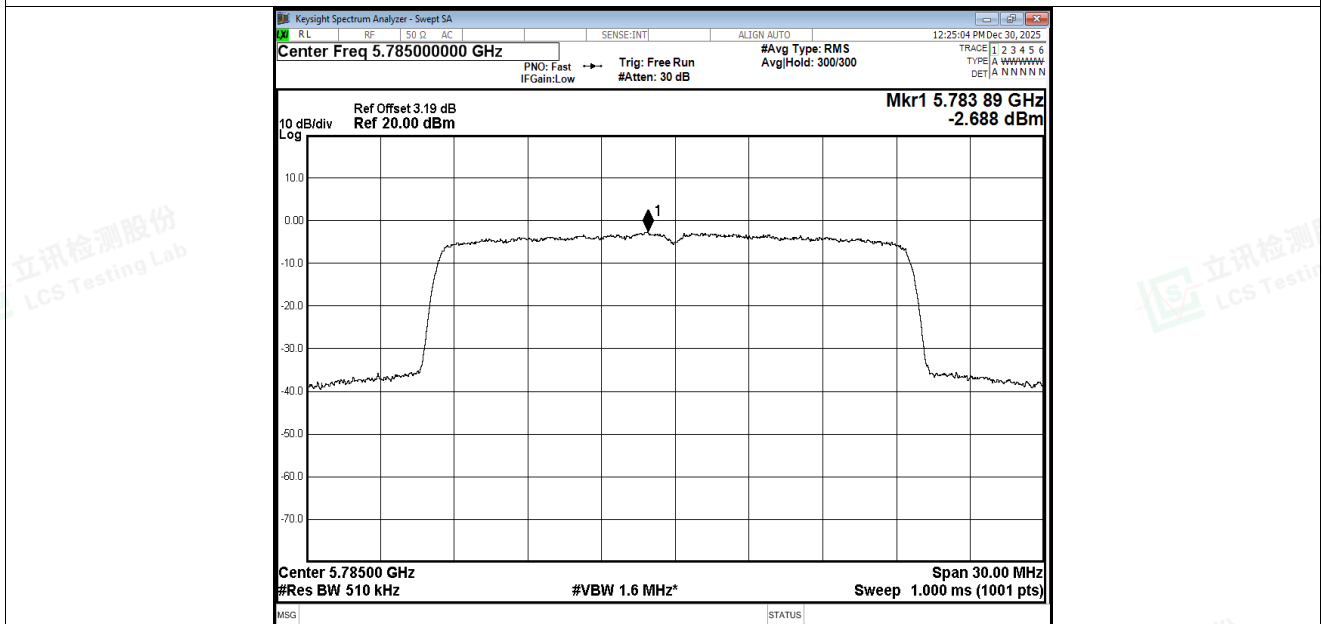

PSD NVNT be20 5785MHz Ant4




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

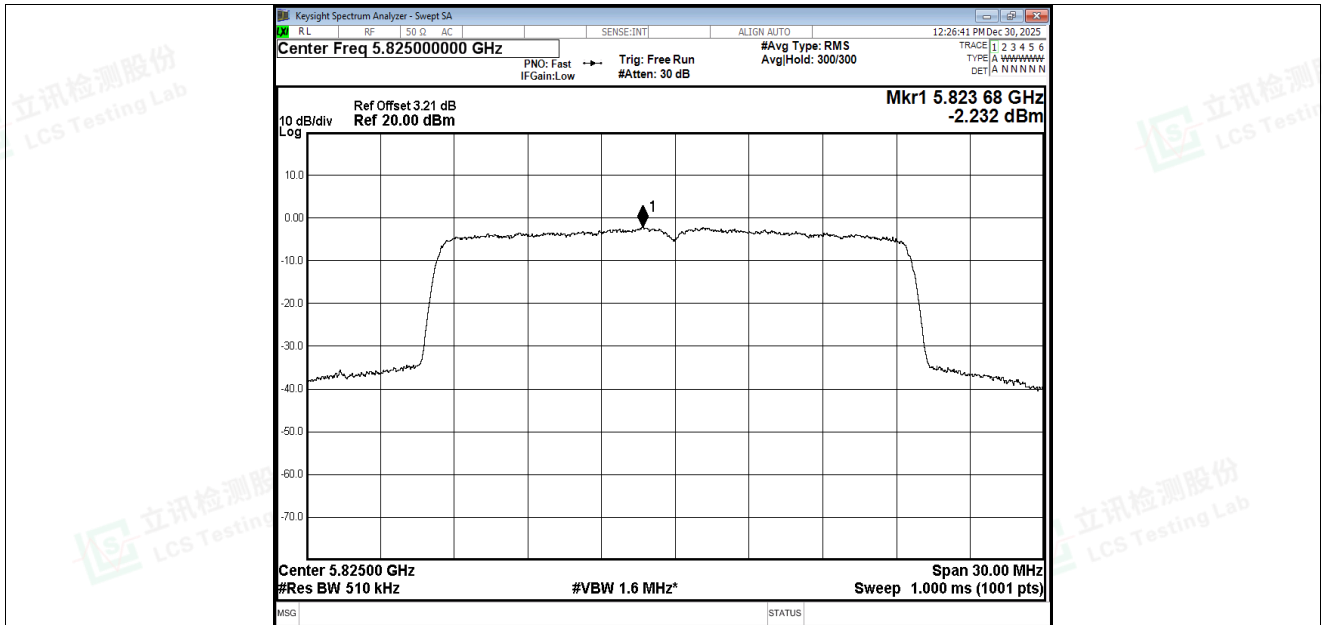

PSD NVNT be20 5825MHz Ant4

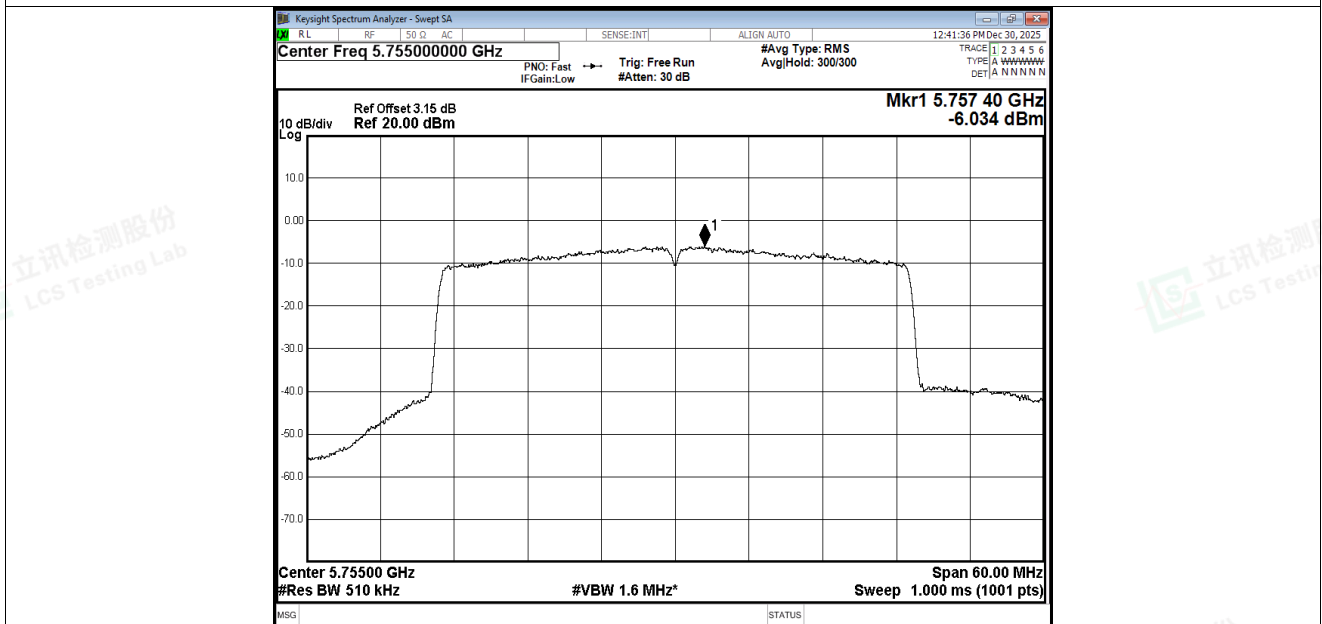

PSD NVNT be40 5755MHz Ant4





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

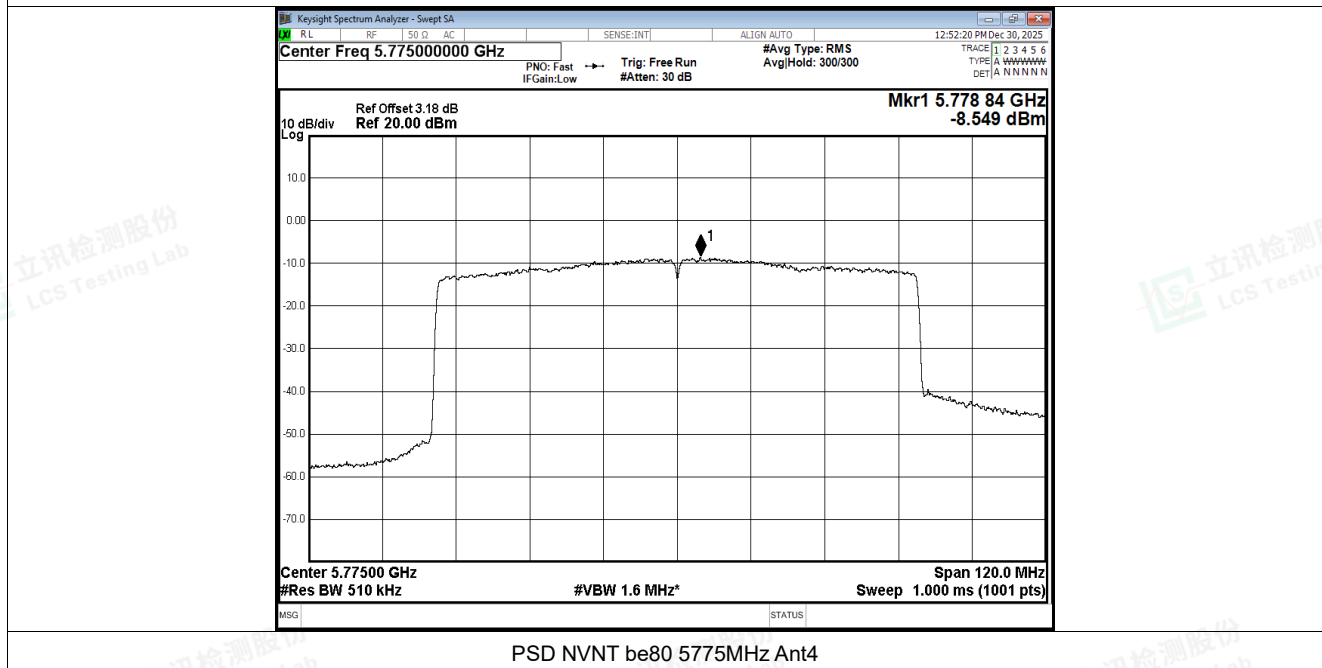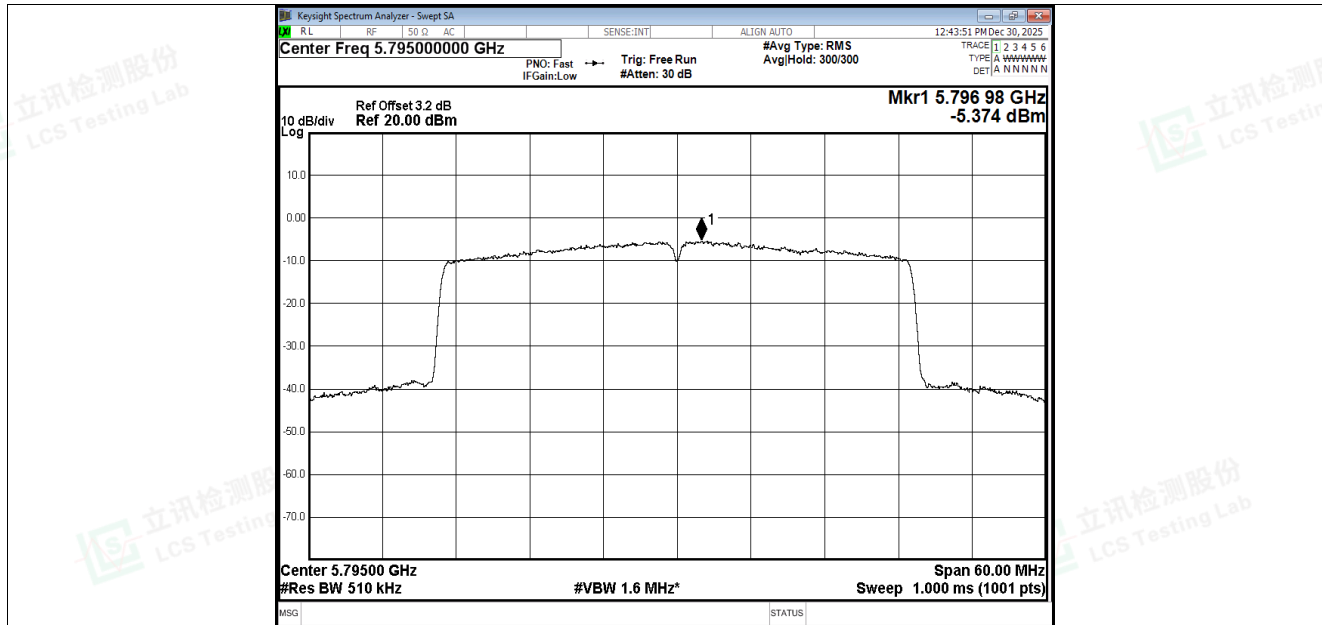


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

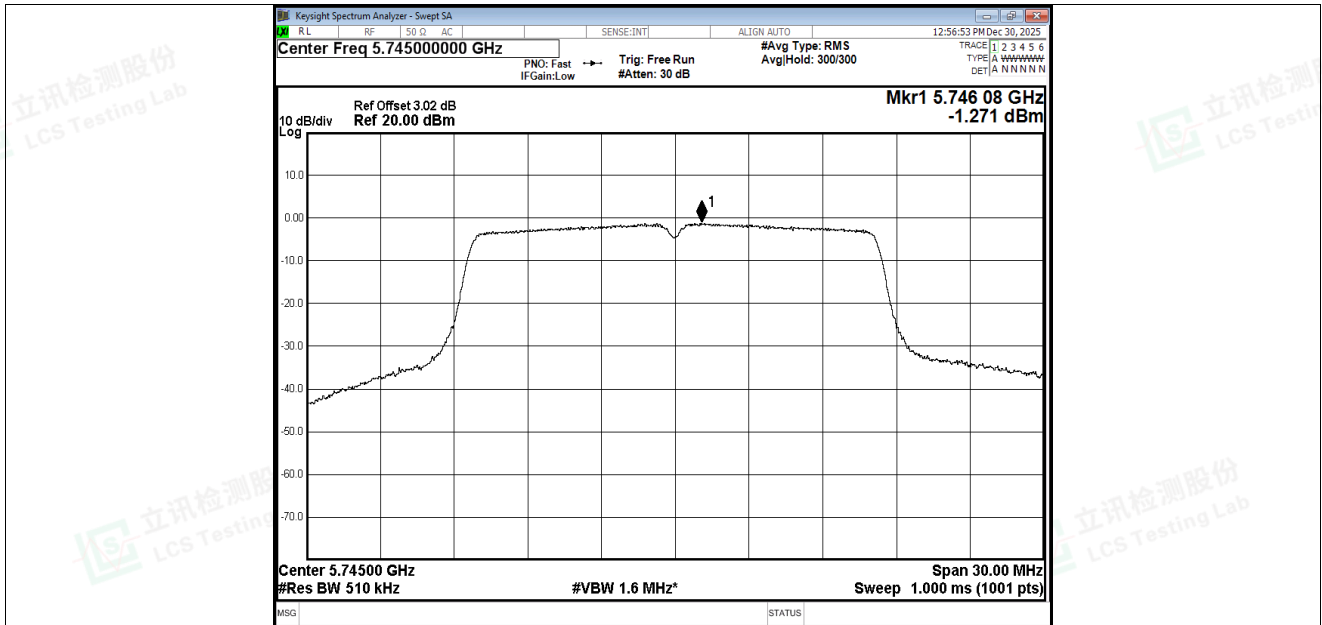

PSD NVNT a 5745MHz Ant5

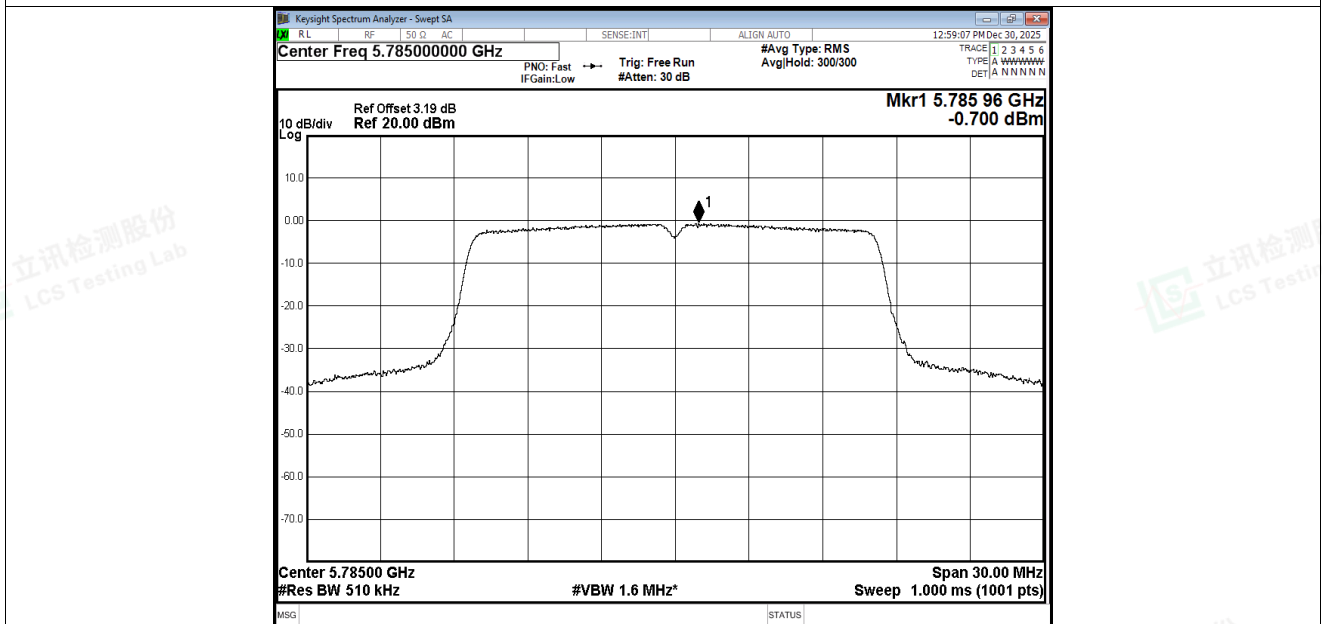

PSD NVNT a 5785MHz Ant5




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

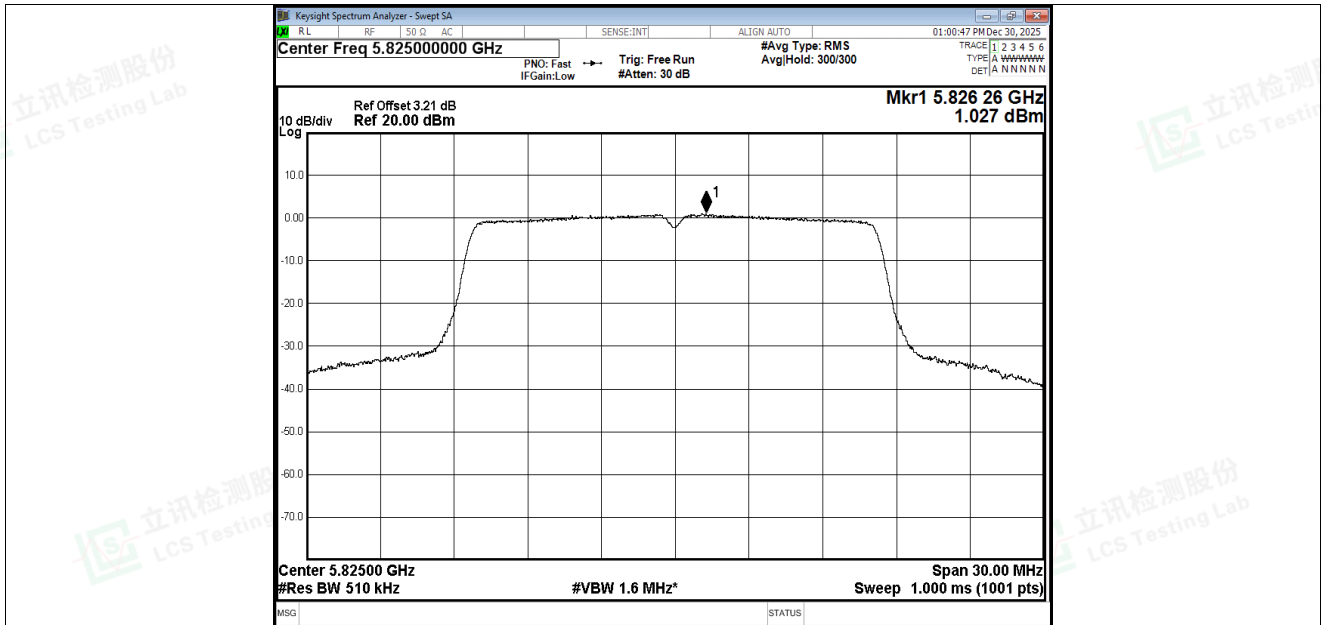

PSD NVNT a 5825MHz Ant5

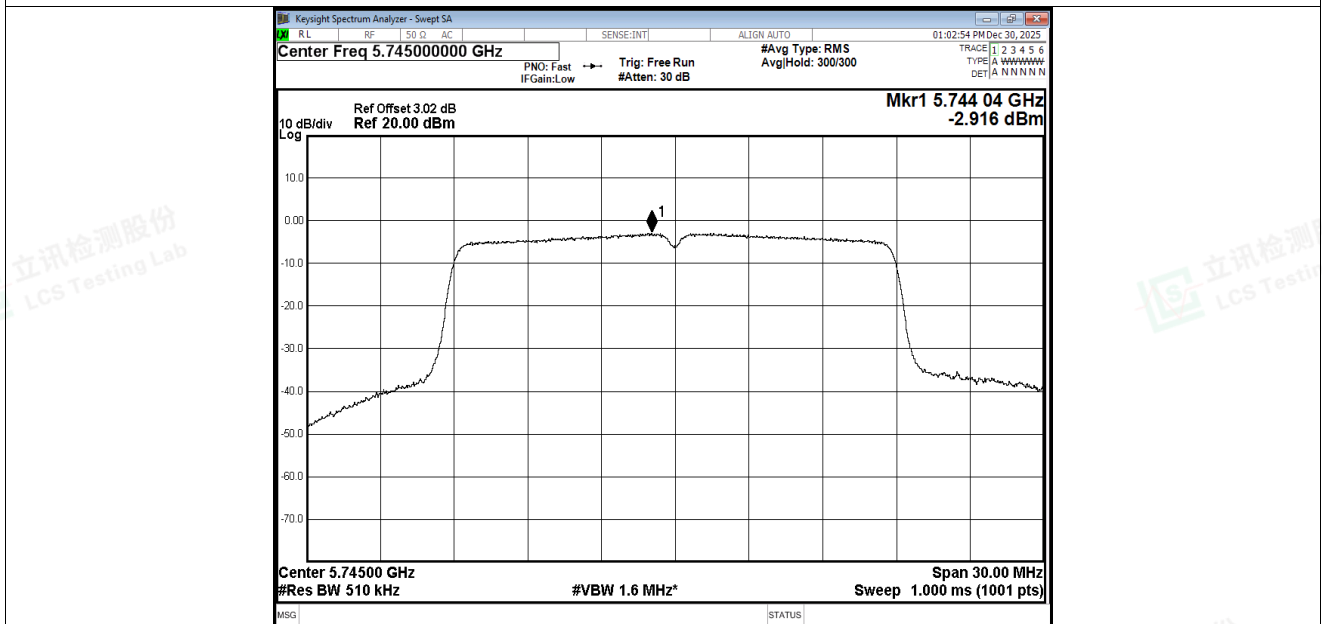

PSD NVNT n20 5745MHz Ant5





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

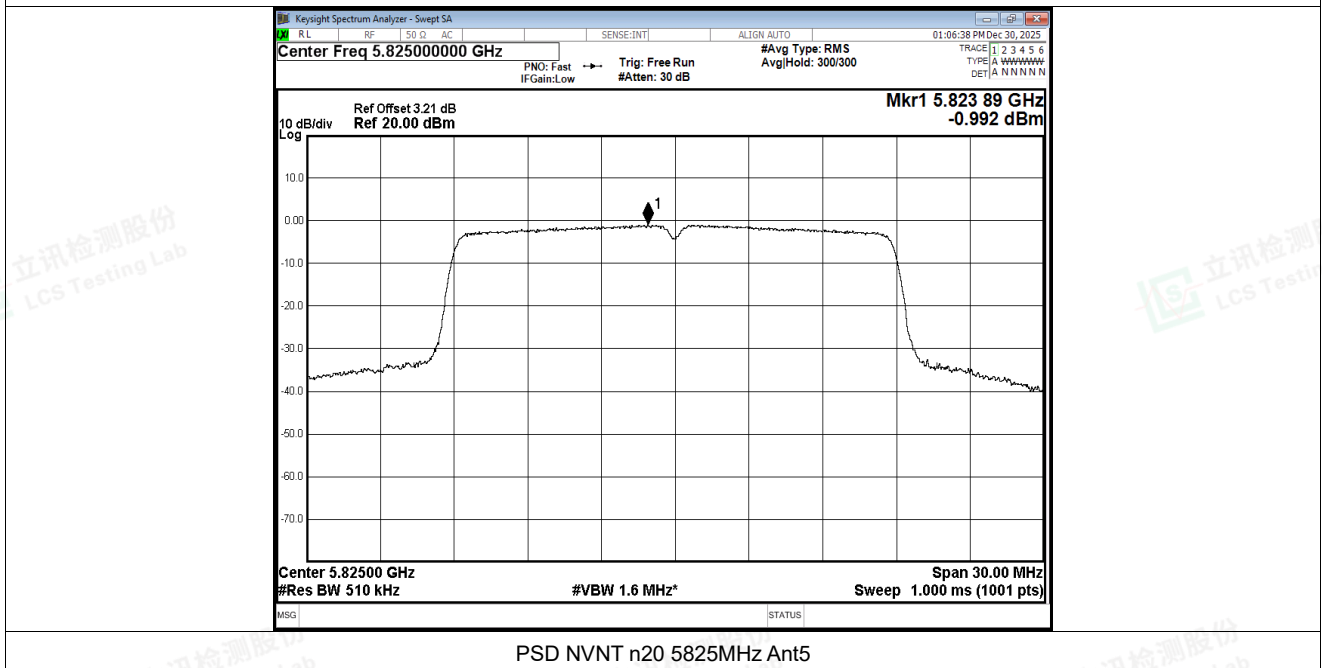
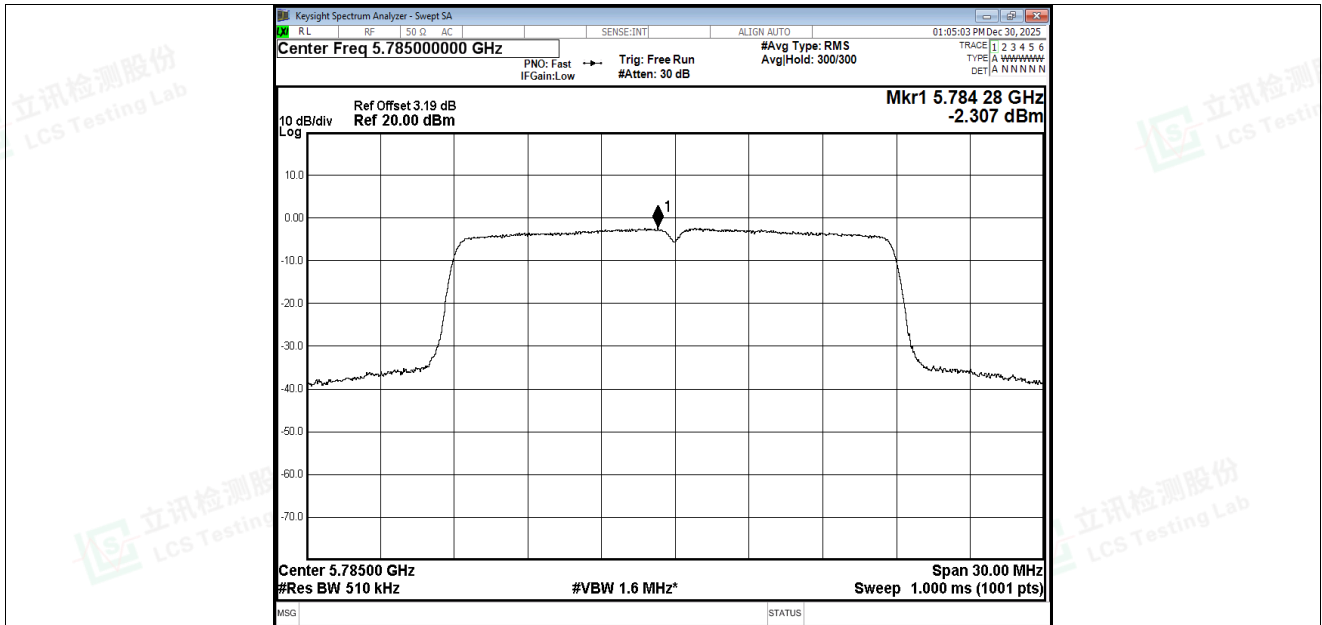


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

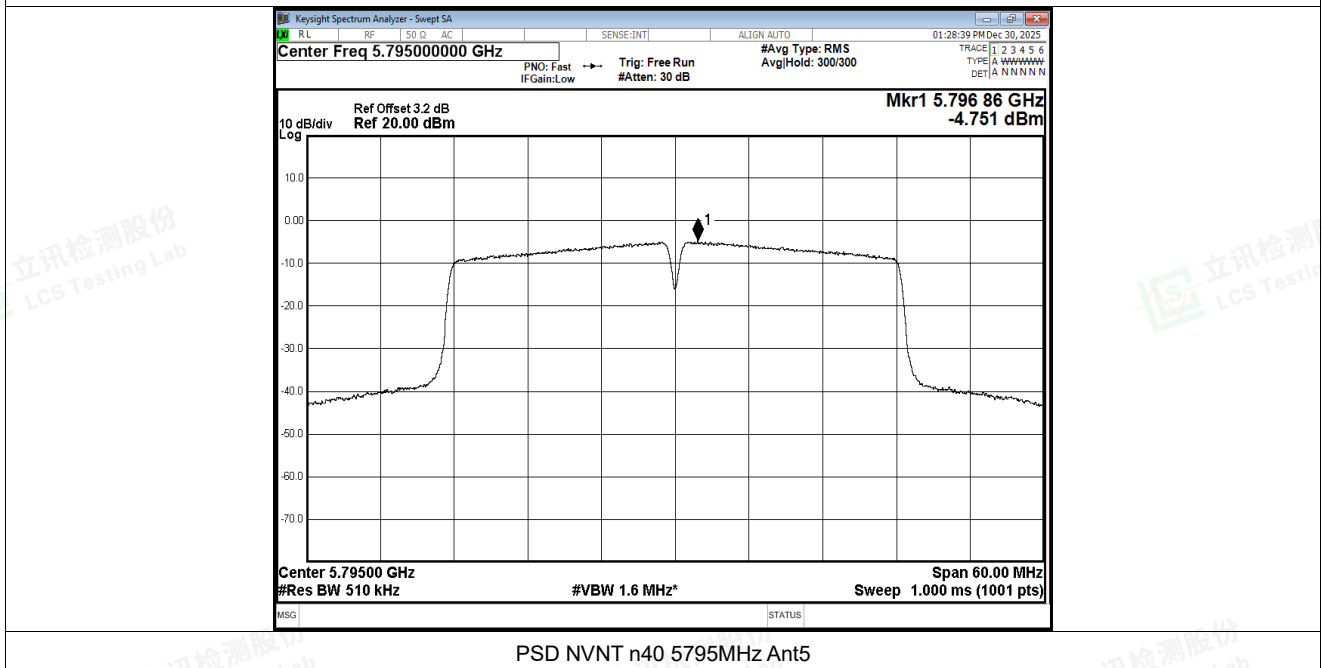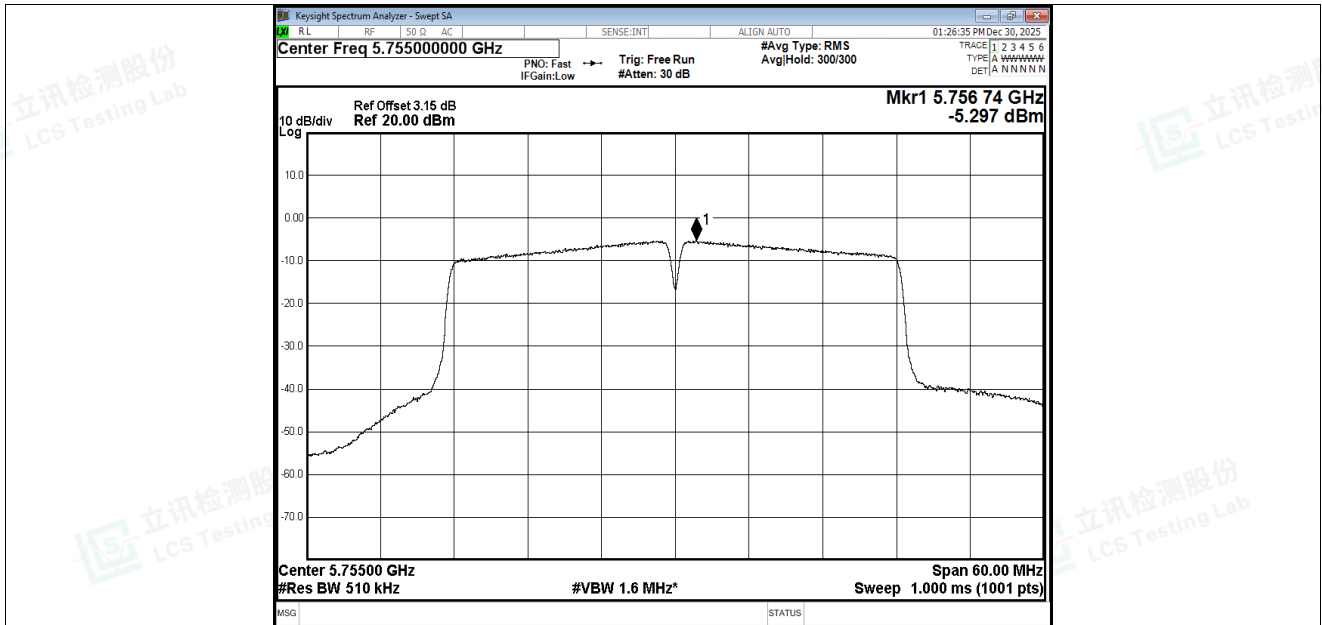


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

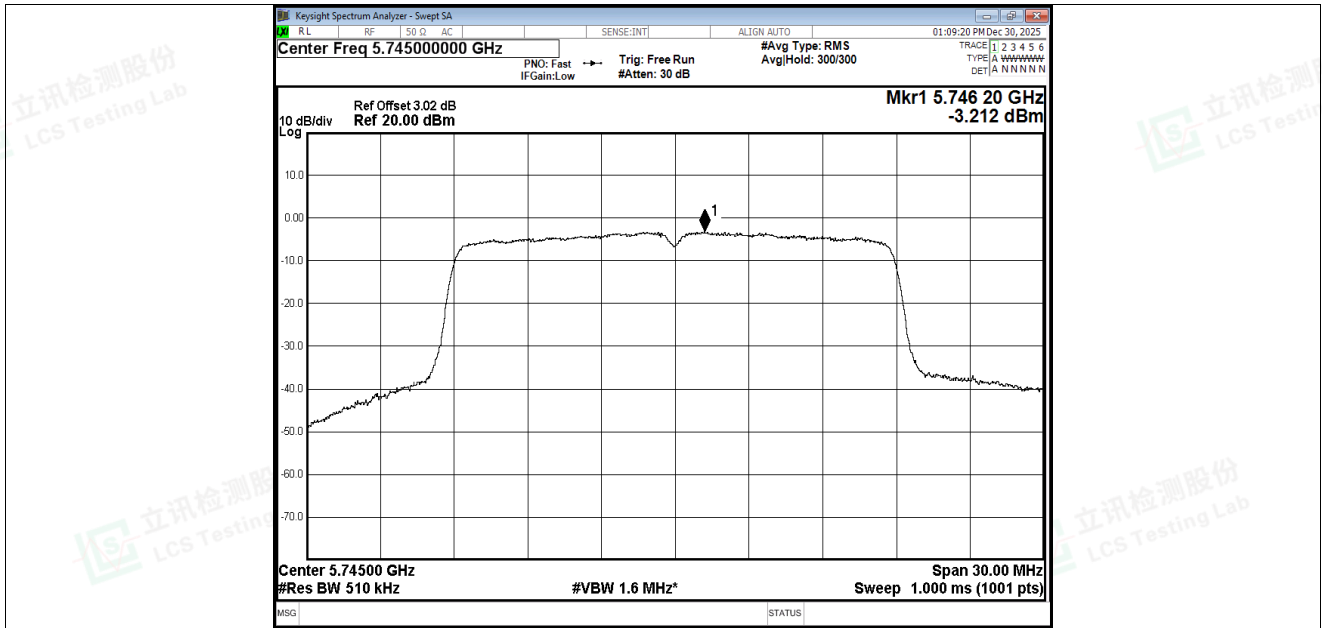

PSD NVNT ac20 5745MHz Ant5

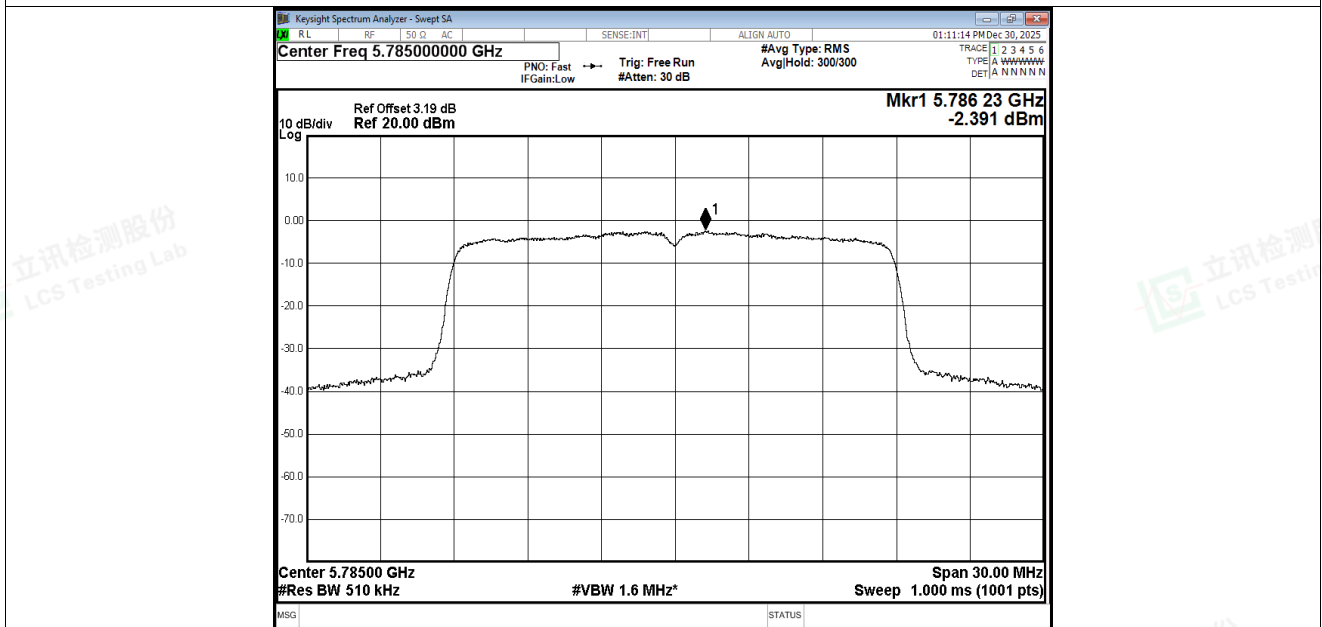

PSD NVNT ac20 5785MHz Ant5




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

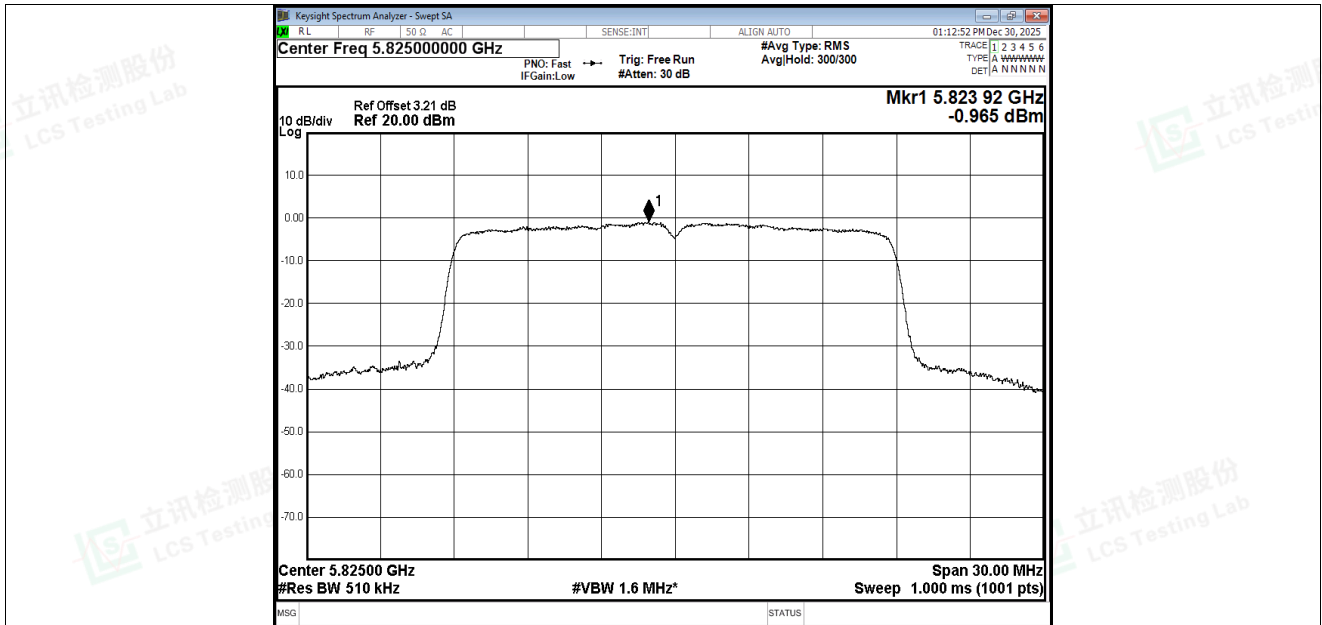

PSD NVNT ac20 5825MHz Ant5

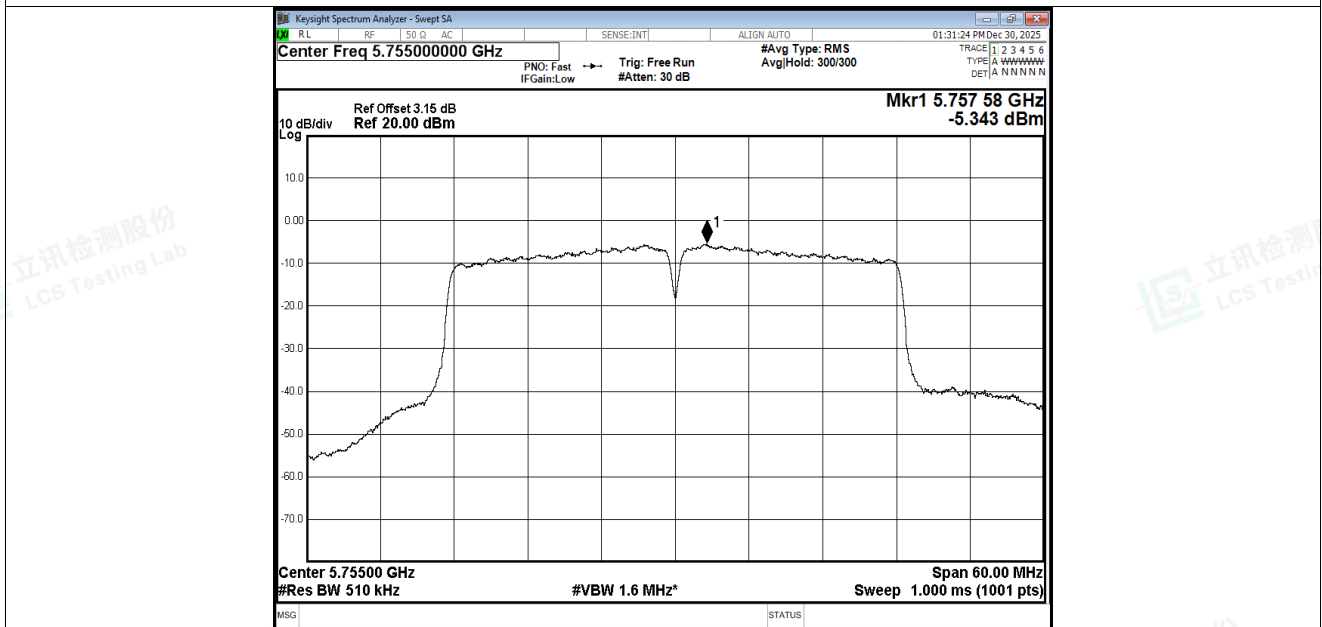

PSD NVNT ac40 5755MHz Ant5





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

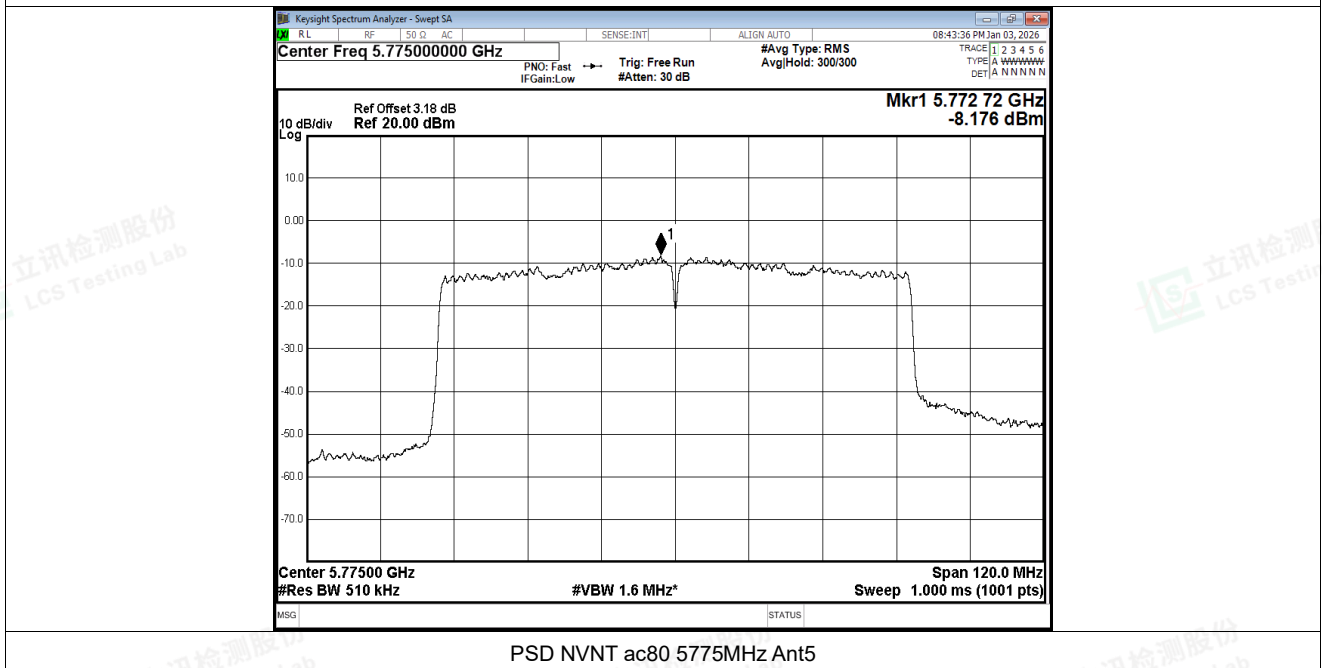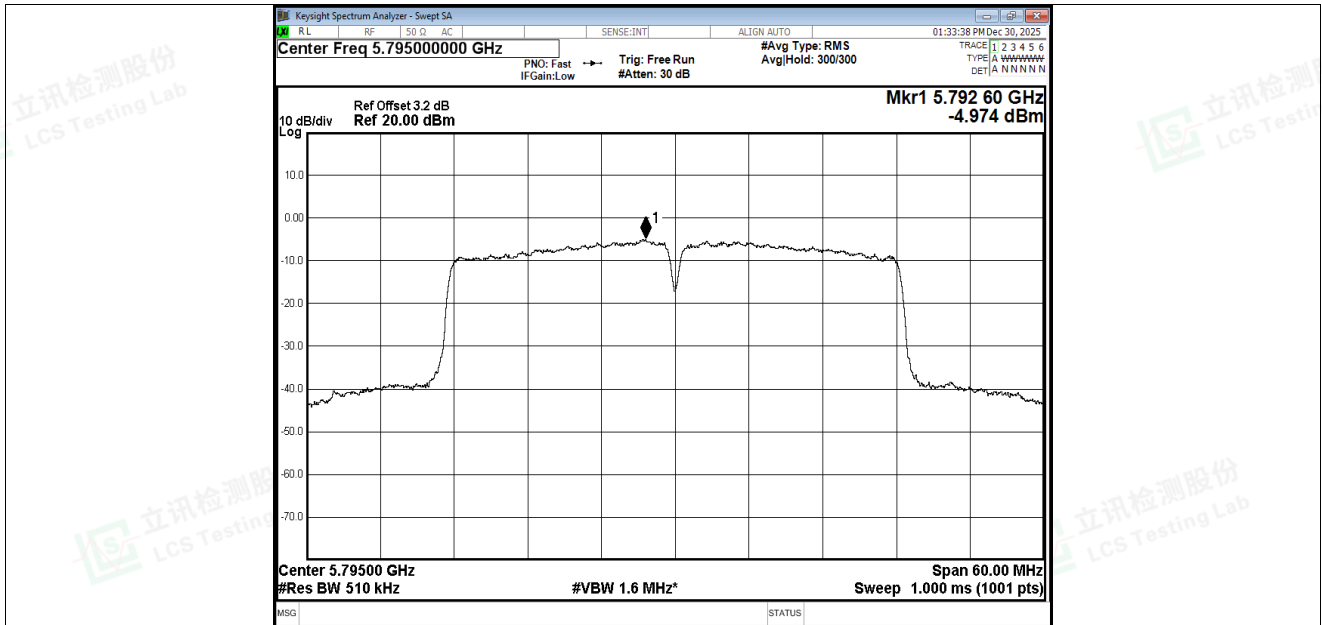


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

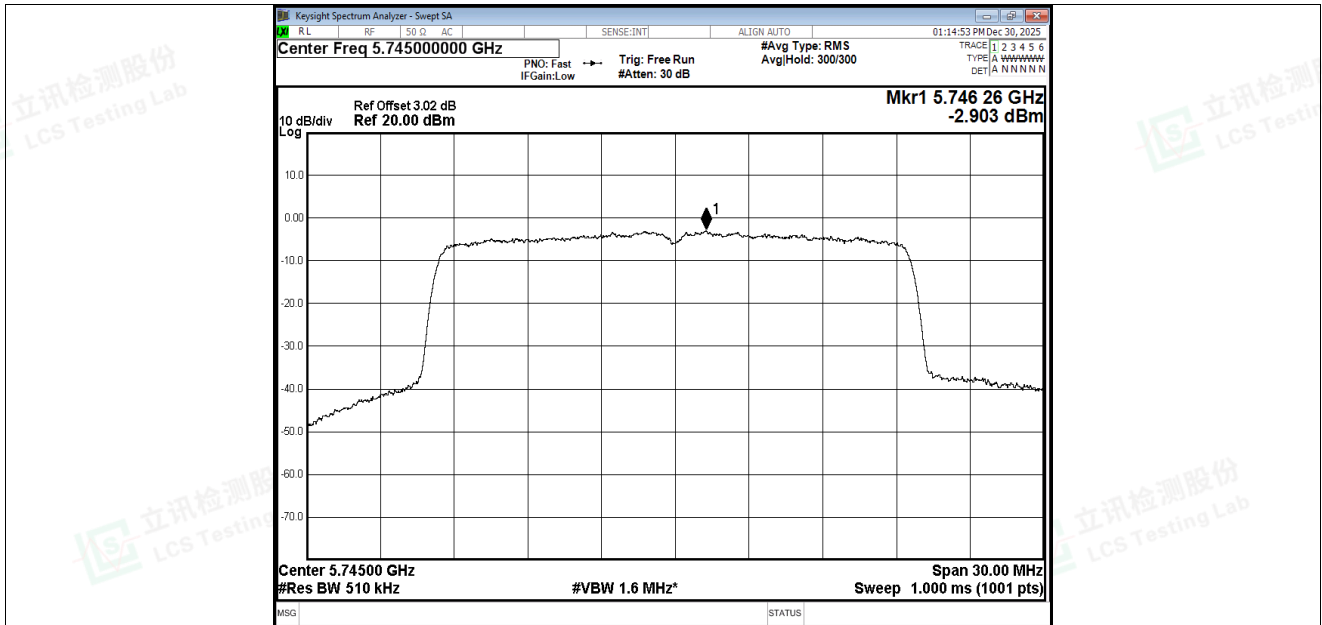

PSD NVNT ax20 5745MHz Ant5

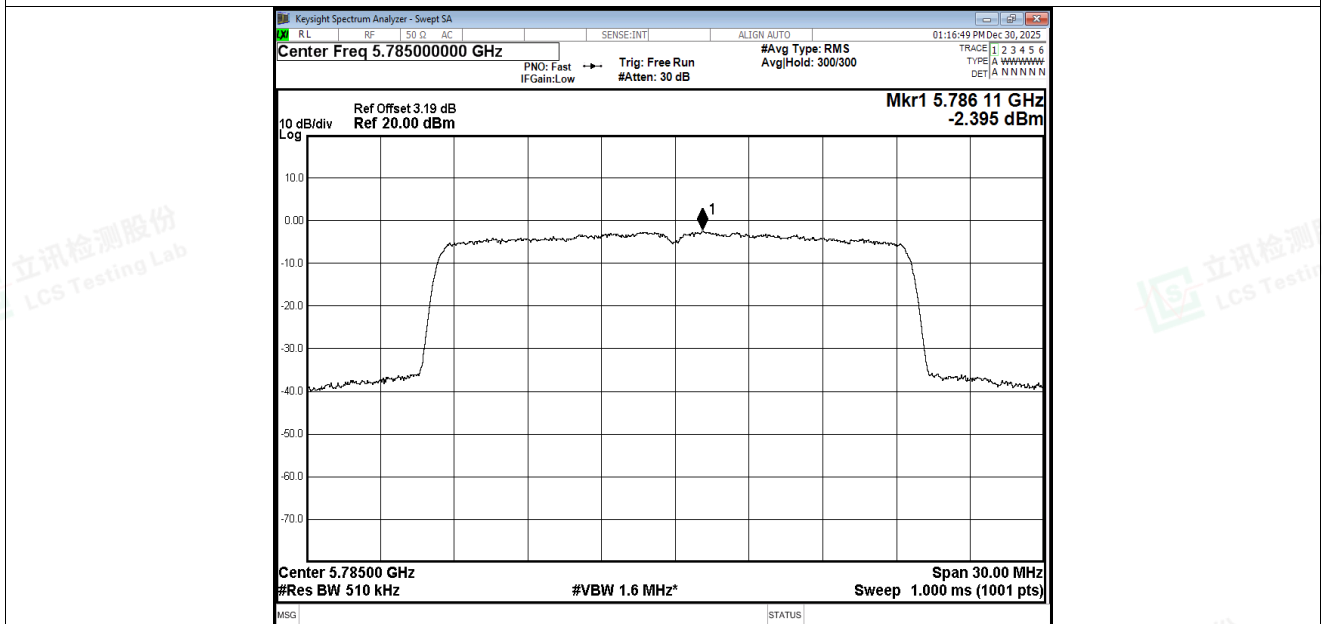

PSD NVNT ax20 5785MHz Ant5





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

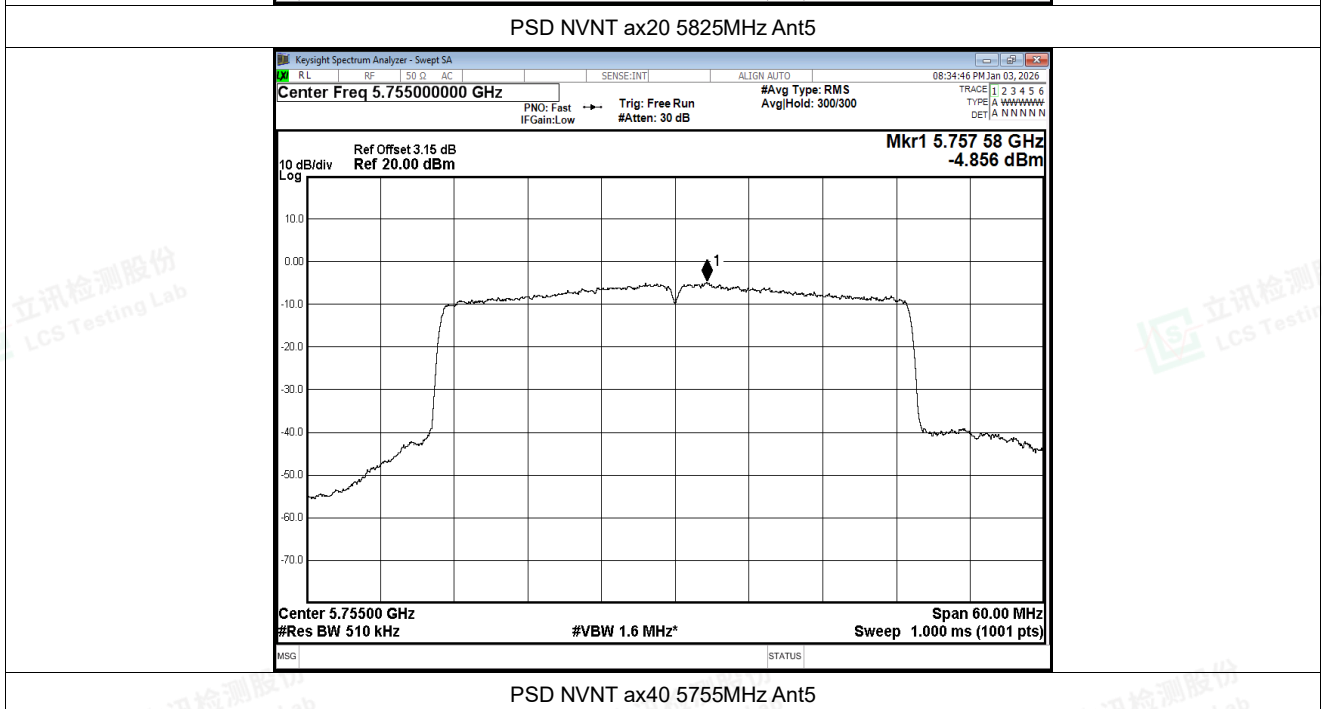
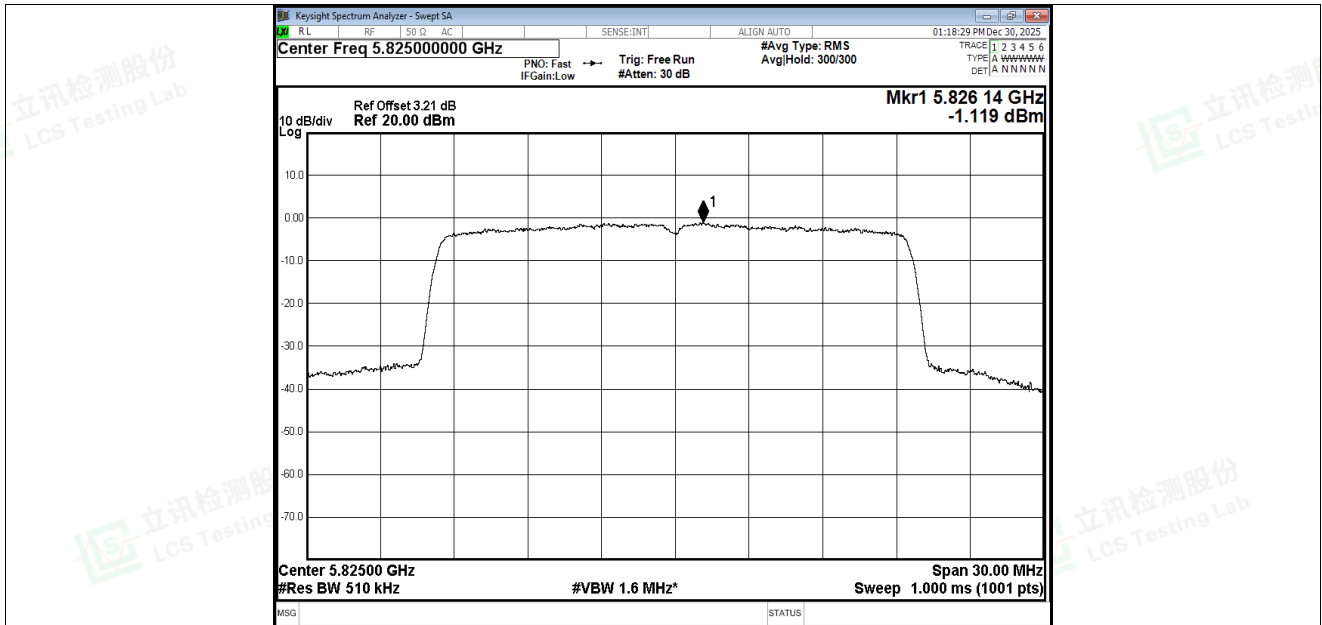


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

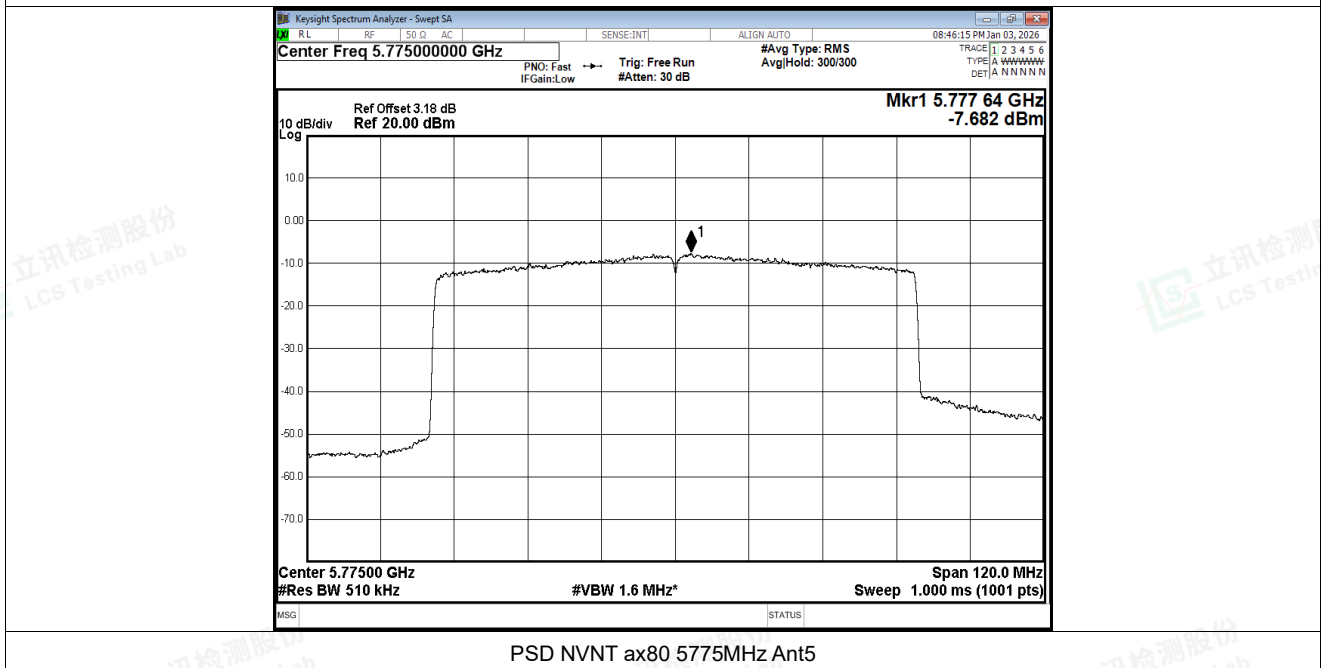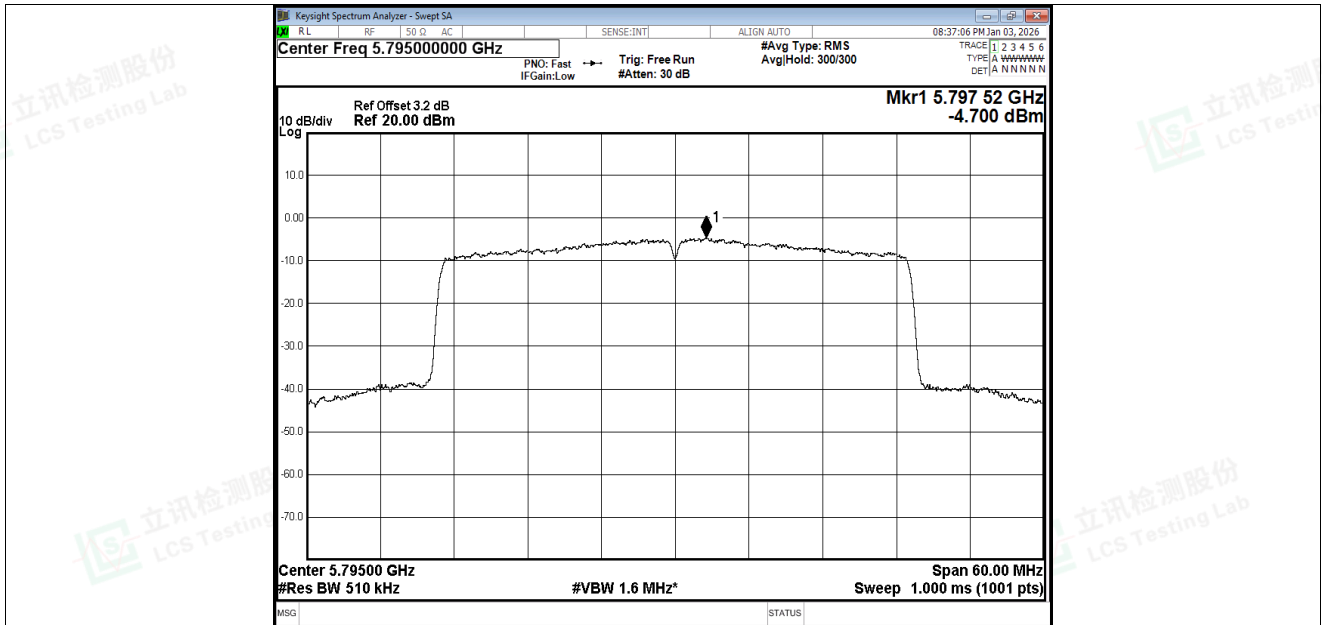


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

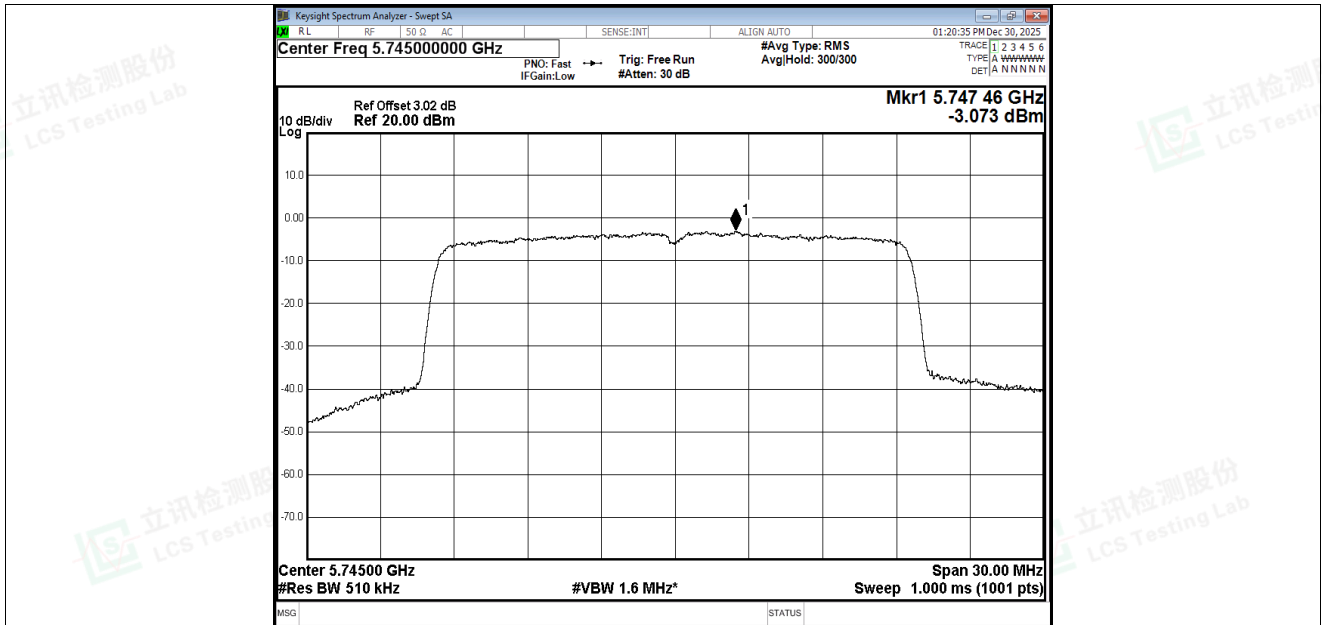

PSD NVNT be20 5745MHz Ant5

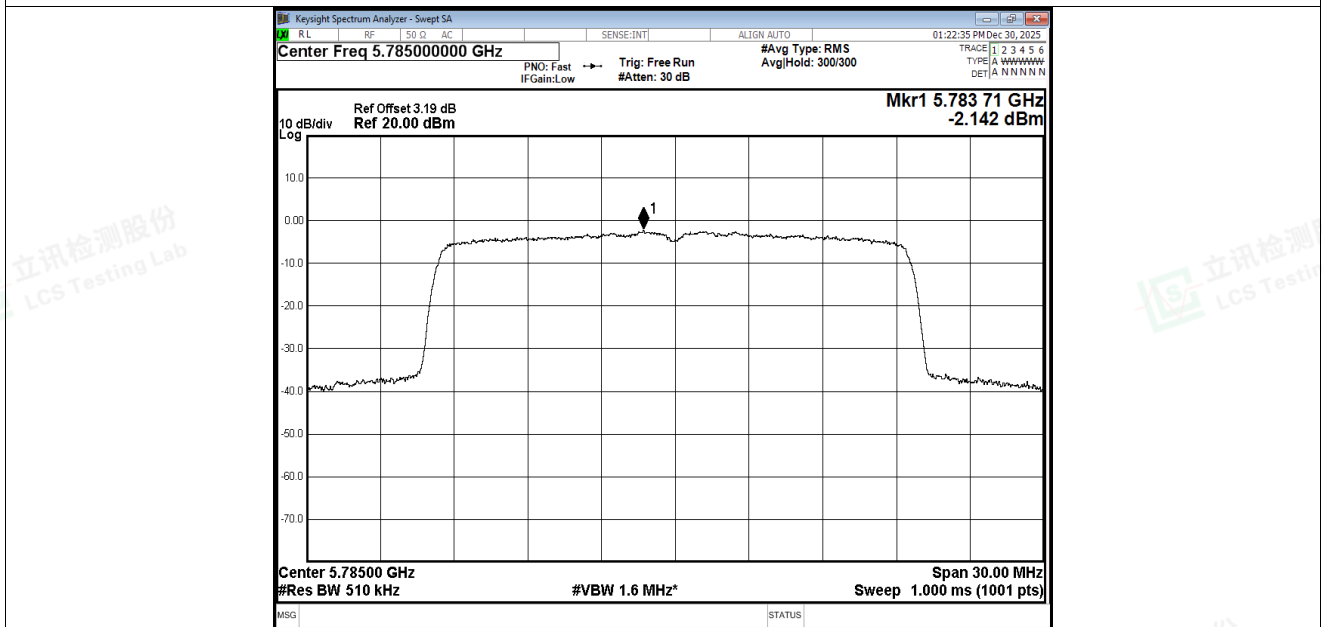

PSD NVNT be20 5785MHz Ant5





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

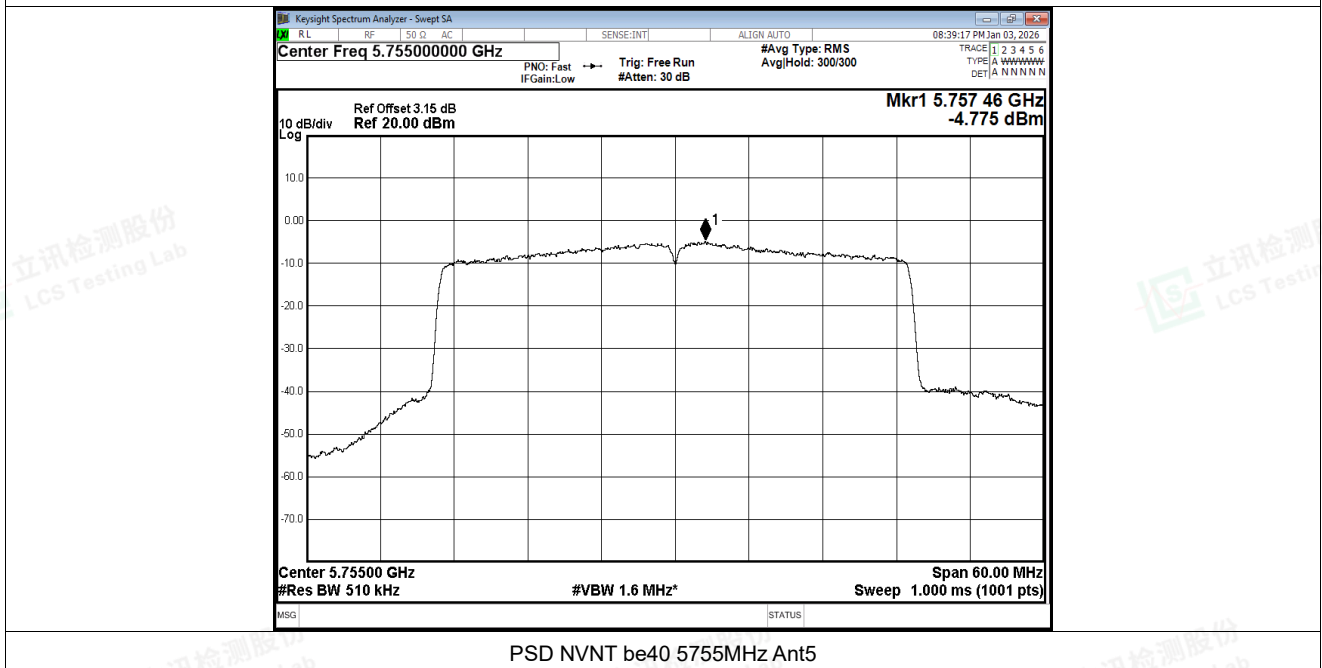
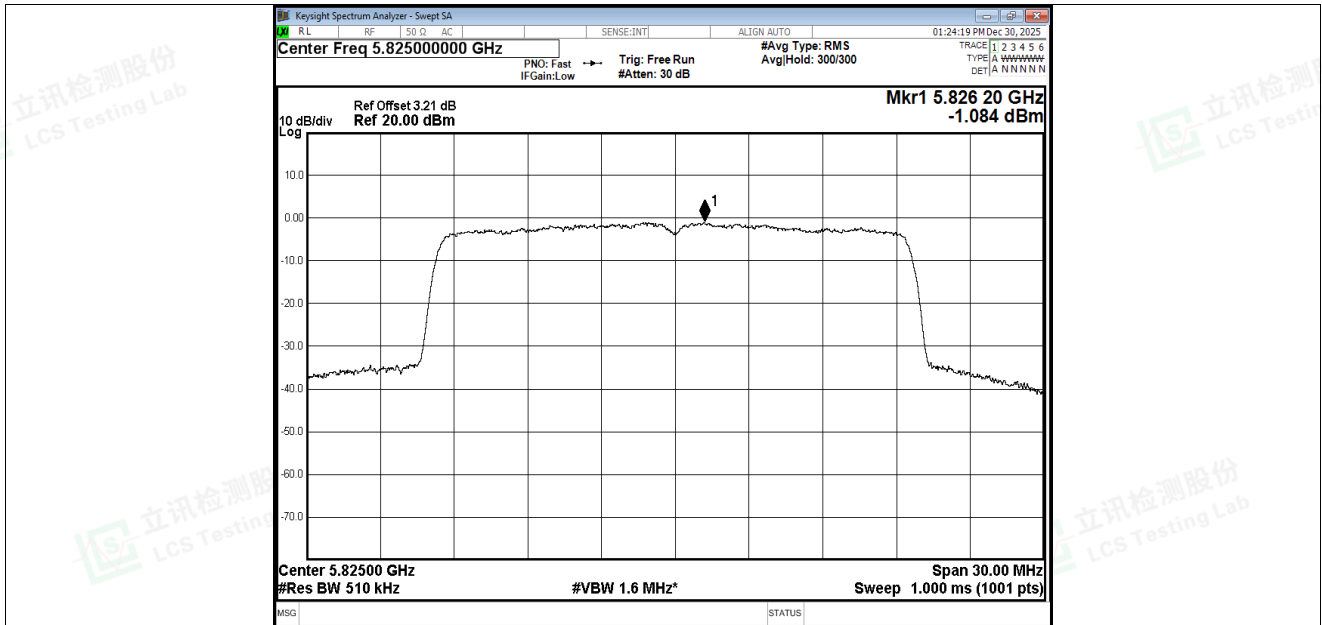


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

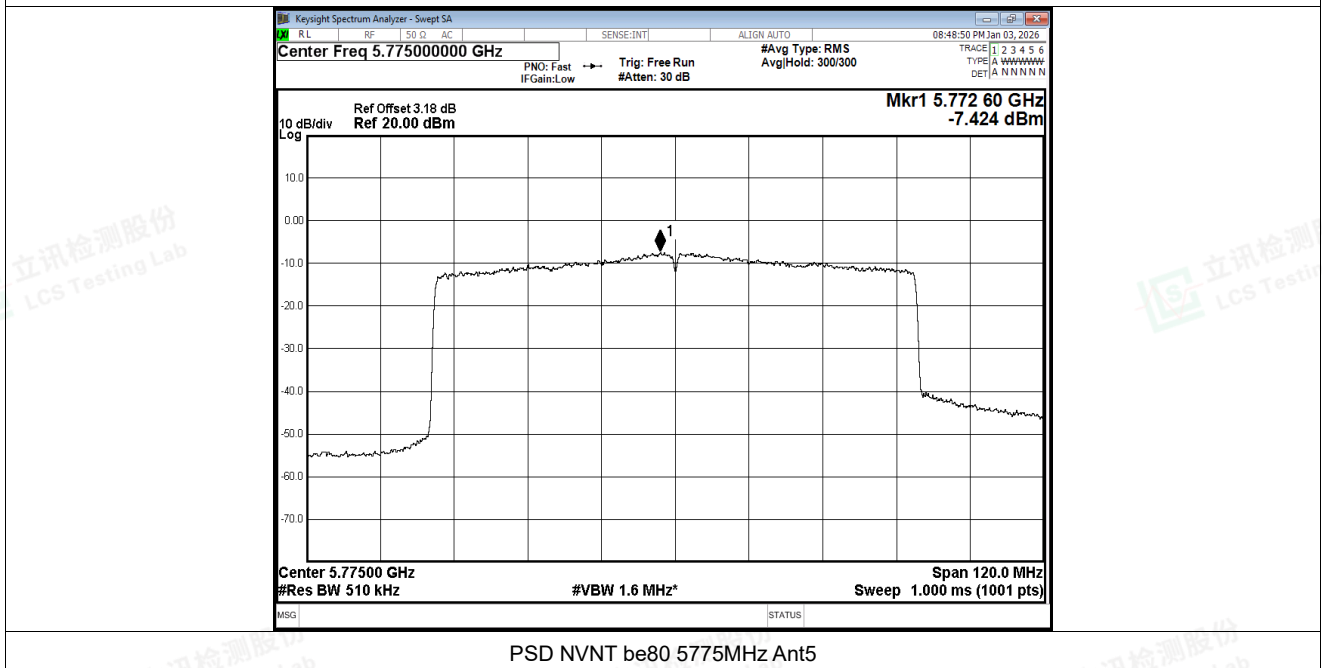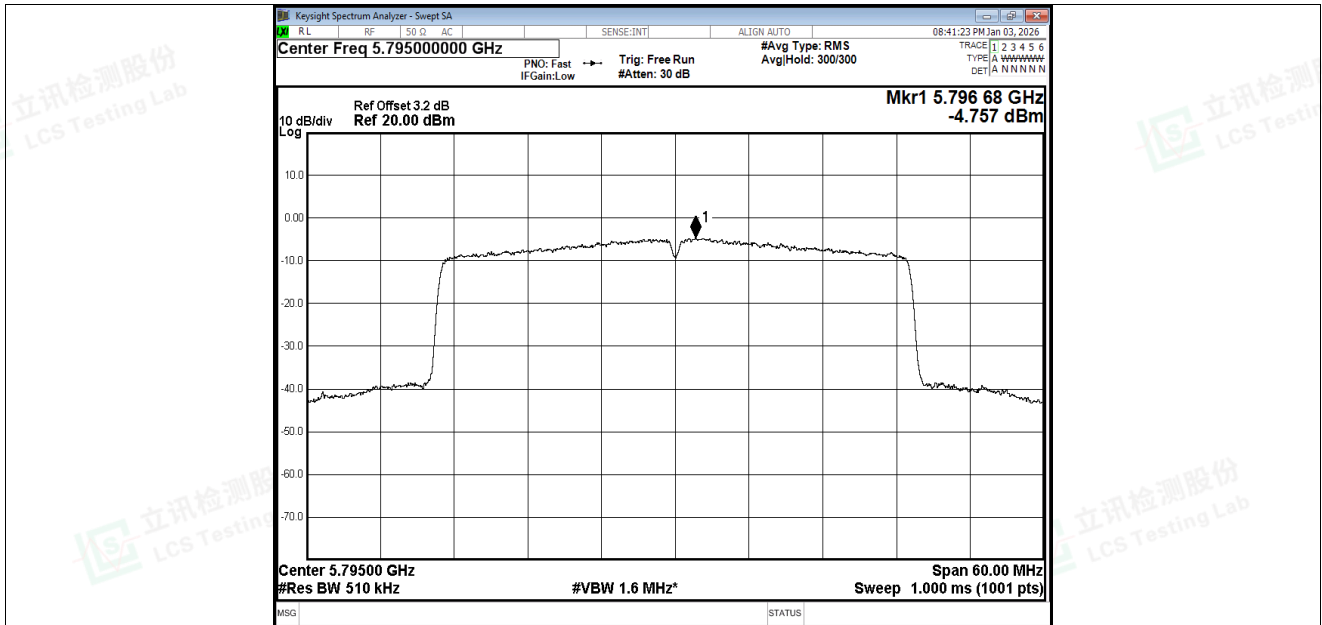

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	EIRP (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant1	5650	-49.51	6.56	-42.95	Peak	-27	Pass
NVNT	a	5745	Ant1	5650	-56.69	6.56	-50.13	Average	-27	Pass
NVNT	a	5745	Ant1	5700	-46.43	6.56	-39.87	Peak	10	Pass
NVNT	a	5745	Ant1	5700	-54.52	6.56	-47.96	Average	10	Pass
NVNT	a	5745	Ant1	5720	-33.79	6.56	-27.23	Peak	15.6	Pass
NVNT	a	5745	Ant1	5720	-44.16	6.56	-37.6	Average	15.6	Pass
NVNT	a	5745	Ant1	5725	-28.72	6.56	-22.16	Peak	27	Pass
NVNT	a	5745	Ant1	5725	-37.36	6.56	-30.8	Average	27	Pass
NVNT	a	5825	Ant1	5850	-43.95	6.56	-37.39	Peak	27	Pass
NVNT	a	5825	Ant1	5850	-51.73	6.56	-45.17	Average	27	Pass
NVNT	a	5825	Ant1	5855	-45.51	6.56	-38.95	Peak	15.6	Pass
NVNT	a	5825	Ant1	5855	-52.9	6.56	-46.34	Average	15.6	Pass
NVNT	a	5825	Ant1	5875	-47.35	6.56	-40.79	Peak	10	Pass
NVNT	a	5825	Ant1	5875	-54.28	6.56	-47.72	Average	10	Pass
NVNT	a	5825	Ant1	5925	-48.88	6.56	-42.32	Peak	-27	Pass
NVNT	a	5825	Ant1	5925	-55.05	6.56	-48.49	Average	-27	Pass
NVNT	n20	5745	Ant1	5650	-48.25	6.56	-41.69	Peak	-27	Pass
NVNT	n20	5745	Ant1	5650	-56.41	6.56	-49.85	Average	-27	Pass
NVNT	n20	5745	Ant1	5700	-46.41	6.56	-39.85	Peak	10	Pass
NVNT	n20	5745	Ant1	5700	-54.94	6.56	-48.38	Average	10	Pass
NVNT	n20	5745	Ant1	5720	-36.72	6.56	-30.16	Peak	15.6	Pass
NVNT	n20	5745	Ant1	5720	-47.67	6.56	-41.11	Average	15.6	Pass
NVNT	n20	5745	Ant1	5725	-33.04	6.56	-26.48	Peak	27	Pass
NVNT	n20	5745	Ant1	5725	-44.53	6.56	-37.97	Average	27	Pass
NVNT	n20	5825	Ant1	5850	-39.56	6.56	-33	Peak	27	Pass
NVNT	n20	5825	Ant1	5850	-50	6.56	-43.44	Average	27	Pass
NVNT	n20	5825	Ant1	5855	-44.18	6.56	-37.62	Peak	15.6	Pass
NVNT	n20	5825	Ant1	5855	-51.98	6.56	-45.42	Average	15.6	Pass
NVNT	n20	5825	Ant1	5875	-47.34	6.56	-40.78	Peak	10	Pass
NVNT	n20	5825	Ant1	5875	-54.03	6.56	-47.47	Average	10	Pass
NVNT	n20	5825	Ant1	5925	-48.35	6.56	-41.79	Peak	-27	Pass
NVNT	n20	5825	Ant1	5925	-54.8	6.56	-48.24	Average	-27	Pass
NVNT	n40	5755	Ant1	5650	-50.04	6.56	-43.48	Peak	-27	Pass
NVNT	n40	5755	Ant1	5650	-55.52	6.56	-48.96	Average	-27	Pass
NVNT	n40	5755	Ant1	5700	-45.47	6.56	-38.91	Peak	10	Pass
NVNT	n40	5755	Ant1	5700	-51.61	6.56	-45.05	Average	10	Pass
NVNT	n40	5755	Ant1	5720	-39.32	6.56	-32.76	Peak	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant1	5720	-47.37	6.56	-40.81	Average	15.6	Pass
NVNT	n40	5755	Ant1	5725	-37.17	6.56	-30.61	Peak	27	Pass
NVNT	n40	5755	Ant1	5725	-45.24	6.56	-38.68	Average	27	Pass
NVNT	n40	5795	Ant1	5850	-37.95	6.56	-31.39	Peak	27	Pass
NVNT	n40	5795	Ant1	5850	-48.08	6.56	-41.52	Average	27	Pass
NVNT	n40	5795	Ant1	5855	-42.92	6.56	-36.36	Peak	15.6	Pass
NVNT	n40	5795	Ant1	5855	-49.76	6.56	-43.2	Average	15.6	Pass
NVNT	n40	5795	Ant1	5875	-44.8	6.56	-38.24	Peak	10	Pass
NVNT	n40	5795	Ant1	5875	-52.86	6.56	-46.3	Average	10	Pass
NVNT	n40	5795	Ant1	5925	-47.81	6.56	-41.25	Peak	-27	Pass
NVNT	n40	5795	Ant1	5925	-53.86	6.56	-47.3	Average	-27	Pass
NVNT	ac20	5745	Ant1	5650	-50.88	6.56	-44.32	Peak	-27	Pass
NVNT	ac20	5745	Ant1	5650	-56.14	6.56	-49.58	Average	-27	Pass
NVNT	ac20	5745	Ant1	5700	-47.28	6.56	-40.72	Peak	10	Pass
NVNT	ac20	5745	Ant1	5700	-54.05	6.56	-47.49	Average	10	Pass
NVNT	ac20	5745	Ant1	5720	-38.87	6.56	-32.31	Peak	15.6	Pass
NVNT	ac20	5745	Ant1	5720	-47.02	6.56	-40.46	Average	15.6	Pass
NVNT	ac20	5745	Ant1	5725	-35.55	6.56	-28.99	Peak	27	Pass
NVNT	ac20	5745	Ant1	5725	-43.04	6.56	-36.48	Average	27	Pass
NVNT	ac20	5825	Ant1	5850	-41.02	6.56	-34.46	Peak	27	Pass
NVNT	ac20	5825	Ant1	5850	-49.65	6.56	-43.09	Average	27	Pass
NVNT	ac20	5825	Ant1	5855	-44.02	6.56	-37.46	Peak	15.6	Pass
NVNT	ac20	5825	Ant1	5855	-51.88	6.56	-45.32	Average	15.6	Pass
NVNT	ac20	5825	Ant1	5875	-48.38	6.56	-41.82	Peak	10	Pass
NVNT	ac20	5825	Ant1	5875	-53.99	6.56	-47.43	Average	10	Pass
NVNT	ac20	5825	Ant1	5925	-47.74	6.56	-41.18	Peak	-27	Pass
NVNT	ac20	5825	Ant1	5925	-54.37	6.56	-47.81	Average	-27	Pass
NVNT	ac40	5755	Ant1	5650	-50.13	6.56	-43.57	Peak	-27	Pass
NVNT	ac40	5755	Ant1	5650	-55.05	6.56	-48.49	Average	-27	Pass
NVNT	ac40	5755	Ant1	5700	-41.82	6.56	-35.26	Peak	10	Pass
NVNT	ac40	5755	Ant1	5700	-50.5	6.56	-43.94	Average	10	Pass
NVNT	ac40	5755	Ant1	5720	-32.08	6.56	-25.52	Peak	15.6	Pass
NVNT	ac40	5755	Ant1	5720	-46.15	6.56	-39.59	Average	15.6	Pass
NVNT	ac40	5755	Ant1	5725	-37.45	6.56	-30.89	Peak	27	Pass
NVNT	ac40	5755	Ant1	5725	-45.54	6.56	-38.98	Average	27	Pass
NVNT	ac40	5795	Ant1	5850	-40.28	6.56	-33.72	Peak	27	Pass
NVNT	ac40	5795	Ant1	5850	-48.53	6.56	-41.97	Average	27	Pass
NVNT	ac40	5795	Ant1	5855	-44.09	6.56	-37.53	Peak	15.6	Pass
NVNT	ac40	5795	Ant1	5855	-49.67	6.56	-43.11	Average	15.6	Pass
NVNT	ac40	5795	Ant1	5875	-48.9	6.56	-42.34	Peak	10	Pass
NVNT	ac40	5795	Ant1	5875	-54.36	6.56	-47.8	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5795	Ant1	5925	-51.15	6.56	-44.59	Peak	-27	Pass
NVNT	ac40	5795	Ant1	5925	-56	6.56	-49.44	Average	-27	Pass
NVNT	ac80	5775	Ant1	5850	-31.26	6.56	-24.7	Peak	27	Pass
NVNT	ac80	5775	Ant1	5850	-37.73	6.56	-31.17	Average	27	Pass
NVNT	ac80	5775	Ant1	5855	-31.14	6.56	-24.58	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5855	-39.22	6.56	-32.66	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5875	-36.56	6.56	-30	Peak	10	Pass
NVNT	ac80	5775	Ant1	5875	-43.05	6.56	-36.49	Average	10	Pass
NVNT	ac80	5775	Ant1	5925	-45.96	6.56	-39.4	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5925	-50.9	6.56	-44.34	Average	-27	Pass
NVNT	ac80	5775	Ant1	5650	-45.69	6.56	-39.13	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5650	-50.94	6.56	-44.38	Average	-27	Pass
NVNT	ac80	5775	Ant1	5700	-42.19	6.56	-35.63	Peak	10	Pass
NVNT	ac80	5775	Ant1	5700	-46.45	6.56	-39.89	Average	10	Pass
NVNT	ac80	5775	Ant1	5720	-41.31	6.56	-34.75	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5720	-44.05	6.56	-37.49	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5725	-38.42	6.56	-31.86	Peak	27	Pass
NVNT	ac80	5775	Ant1	5725	-44.84	6.56	-38.28	Average	27	Pass
NVNT	ax20	5745	Ant1	5650	-47.57	6.56	-41.01	Peak	-27	Pass
NVNT	ax20	5745	Ant1	5650	-55.85	6.56	-49.29	Average	-27	Pass
NVNT	ax20	5745	Ant1	5700	-48.83	6.56	-42.27	Peak	10	Pass
NVNT	ax20	5745	Ant1	5700	-53.71	6.56	-47.15	Average	10	Pass
NVNT	ax20	5745	Ant1	5720	-37.2	6.56	-30.64	Peak	15.6	Pass
NVNT	ax20	5745	Ant1	5720	-44.32	6.56	-37.76	Average	15.6	Pass
NVNT	ax20	5745	Ant1	5725	-35.23	6.56	-28.67	Peak	27	Pass
NVNT	ax20	5745	Ant1	5725	-42.19	6.56	-35.63	Average	27	Pass
NVNT	ax20	5825	Ant1	5850	-39.05	6.56	-32.49	Peak	27	Pass
NVNT	ax20	5825	Ant1	5850	-46.45	6.56	-39.89	Average	27	Pass
NVNT	ax20	5825	Ant1	5855	-41.85	6.56	-35.29	Peak	15.6	Pass
NVNT	ax20	5825	Ant1	5855	-50.69	6.56	-44.13	Average	15.6	Pass
NVNT	ax20	5825	Ant1	5875	-47.33	6.56	-40.77	Peak	10	Pass
NVNT	ax20	5825	Ant1	5875	-53.26	6.56	-46.7	Average	10	Pass
NVNT	ax20	5825	Ant1	5925	-47.06	6.56	-40.5	Peak	-27	Pass
NVNT	ax20	5825	Ant1	5925	-54.53	6.56	-47.97	Average	-27	Pass
NVNT	ax40	5755	Ant1	5650	-48.53	6.56	-41.97	Peak	-27	Pass
NVNT	ax40	5755	Ant1	5650	-55.37	6.56	-48.81	Average	-27	Pass
NVNT	ax40	5755	Ant1	5700	-43.73	6.56	-37.17	Peak	10	Pass
NVNT	ax40	5755	Ant1	5700	-51	6.56	-44.44	Average	10	Pass
NVNT	ax40	5755	Ant1	5720	-38.24	6.56	-31.68	Peak	15.6	Pass
NVNT	ax40	5755	Ant1	5720	-45.44	6.56	-38.88	Average	15.6	Pass
NVNT	ax40	5755	Ant1	5725	-37.89	6.56	-31.33	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5755	Ant1	5725	-44.93	6.56	-38.37	Average	27	Pass
NVNT	ax40	5795	Ant1	5850	-38.43	6.56	-31.87	Peak	27	Pass
NVNT	ax40	5795	Ant1	5850	-47.23	6.56	-40.67	Average	27	Pass
NVNT	ax40	5795	Ant1	5855	-39.71	6.56	-33.15	Peak	15.6	Pass
NVNT	ax40	5795	Ant1	5855	-49.05	6.56	-42.49	Average	15.6	Pass
NVNT	ax40	5795	Ant1	5875	-45.94	6.56	-39.38	Peak	10	Pass
NVNT	ax40	5795	Ant1	5875	-52.25	6.56	-45.69	Average	10	Pass
NVNT	ax40	5795	Ant1	5925	-47.76	6.56	-41.2	Peak	-27	Pass
NVNT	ax40	5795	Ant1	5925	-53.73	6.56	-47.17	Average	-27	Pass
NVNT	ax80	5775	Ant1	5850	-29.12	6.56	-22.56	Peak	27	Pass
NVNT	ax80	5775	Ant1	5850	-37.5	6.56	-30.94	Average	27	Pass
NVNT	ax80	5775	Ant1	5855	-32.66	6.56	-26.1	Peak	15.6	Pass
NVNT	ax80	5775	Ant1	5855	-38.54	6.56	-31.98	Average	15.6	Pass
NVNT	ax80	5775	Ant1	5875	-34.65	6.56	-28.09	Peak	10	Pass
NVNT	ax80	5775	Ant1	5875	-41.87	6.56	-35.31	Average	10	Pass
NVNT	ax80	5775	Ant1	5925	-43.61	6.56	-37.05	Peak	-27	Pass
NVNT	ax80	5775	Ant1	5925	-50.38	6.56	-43.82	Average	-27	Pass
NVNT	ax80	5775	Ant1	5650	-45.17	6.56	-38.61	Peak	-27	Pass
NVNT	ax80	5775	Ant1	5650	-50.68	6.56	-44.12	Average	-27	Pass
NVNT	ax80	5775	Ant1	5700	-37.31	6.56	-30.75	Peak	10	Pass
NVNT	ax80	5775	Ant1	5700	-45.61	6.56	-39.05	Average	10	Pass
NVNT	ax80	5775	Ant1	5720	-39.72	6.56	-33.16	Peak	15.6	Pass
NVNT	ax80	5775	Ant1	5720	-45.41	6.56	-38.85	Average	15.6	Pass
NVNT	ax80	5775	Ant1	5725	-38.12	6.56	-31.56	Peak	27	Pass
NVNT	ax80	5775	Ant1	5725	-45.32	6.56	-38.76	Average	27	Pass
NVNT	be20	5745	Ant1	5650	-50.73	6.56	-44.17	Peak	-27	Pass
NVNT	be20	5745	Ant1	5650	-55.88	6.56	-49.32	Average	-27	Pass
NVNT	be20	5745	Ant1	5700	-45.95	6.56	-39.39	Peak	10	Pass
NVNT	be20	5745	Ant1	5700	-53.51	6.56	-46.95	Average	10	Pass
NVNT	be20	5745	Ant1	5720	-35.57	6.56	-29.01	Peak	15.6	Pass
NVNT	be20	5745	Ant1	5720	-45.86	6.56	-39.3	Average	15.6	Pass
NVNT	be20	5745	Ant1	5725	-30.74	6.56	-24.18	Peak	27	Pass
NVNT	be20	5745	Ant1	5725	-41.49	6.56	-34.93	Average	27	Pass
NVNT	be20	5825	Ant1	5850	-37.23	6.56	-30.67	Peak	27	Pass
NVNT	be20	5825	Ant1	5850	-46.42	6.56	-39.86	Average	27	Pass
NVNT	be20	5825	Ant1	5855	-42.49	6.56	-35.93	Peak	15.6	Pass
NVNT	be20	5825	Ant1	5855	-50.38	6.56	-43.82	Average	15.6	Pass
NVNT	be20	5825	Ant1	5875	-46.18	6.56	-39.62	Peak	10	Pass
NVNT	be20	5825	Ant1	5875	-53.75	6.56	-47.19	Average	10	Pass
NVNT	be20	5825	Ant1	5925	-49.13	6.56	-42.57	Peak	-27	Pass
NVNT	be20	5825	Ant1	5925	-54.6	6.56	-48.04	Average	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5755	Ant1	5650	-49.39	6.56	-42.83	Peak	-27	Pass
NVNT	be40	5755	Ant1	5650	-55.14	6.56	-48.58	Average	-27	Pass
NVNT	be40	5755	Ant1	5700	-44.01	6.56	-37.45	Peak	10	Pass
NVNT	be40	5755	Ant1	5700	-47.67	6.56	-41.11	Average	10	Pass
NVNT	be40	5755	Ant1	5720	-36.09	6.56	-29.53	Peak	15.6	Pass
NVNT	be40	5755	Ant1	5720	-41.44	6.56	-34.88	Average	15.6	Pass
NVNT	be40	5755	Ant1	5725	-36.57	6.56	-30.01	Peak	27	Pass
NVNT	be40	5755	Ant1	5725	-39.73	6.56	-33.17	Average	27	Pass
NVNT	be40	5795	Ant1	5850	-38.51	6.56	-31.95	Peak	27	Pass
NVNT	be40	5795	Ant1	5850	-46.17	6.56	-39.61	Average	27	Pass
NVNT	be40	5795	Ant1	5855	-41.73	6.56	-35.17	Peak	15.6	Pass
NVNT	be40	5795	Ant1	5855	-48.5	6.56	-41.94	Average	15.6	Pass
NVNT	be40	5795	Ant1	5875	-44.48	6.56	-37.92	Peak	10	Pass
NVNT	be40	5795	Ant1	5875	-52.58	6.56	-46.02	Average	10	Pass
NVNT	be40	5795	Ant1	5925	-47.16	6.56	-40.6	Peak	-27	Pass
NVNT	be40	5795	Ant1	5925	-53.33	6.56	-46.77	Average	-27	Pass
NVNT	be80	5775	Ant1	5850	-32.5	6.56	-25.94	Peak	27	Pass
NVNT	be80	5775	Ant1	5850	-39.54	6.56	-32.98	Average	27	Pass
NVNT	be80	5775	Ant1	5855	-29.72	6.56	-23.16	Peak	15.6	Pass
NVNT	be80	5775	Ant1	5855	-40.38	6.56	-33.82	Average	15.6	Pass
NVNT	be80	5775	Ant1	5875	-35.41	6.56	-28.85	Peak	10	Pass
NVNT	be80	5775	Ant1	5875	-44.26	6.56	-37.7	Average	10	Pass
NVNT	be80	5775	Ant1	5925	-43.73	6.56	-37.17	Peak	-27	Pass
NVNT	be80	5775	Ant1	5925	-51.73	6.56	-45.17	Average	-27	Pass
NVNT	be80	5775	Ant1	5650	-45.33	6.56	-38.77	Peak	-27	Pass
NVNT	be80	5775	Ant1	5650	-51.54	6.56	-44.98	Average	-27	Pass
NVNT	be80	5775	Ant1	5700	-40.14	6.56	-33.58	Peak	10	Pass
NVNT	be80	5775	Ant1	5700	-46.24	6.56	-39.68	Average	10	Pass
NVNT	be80	5775	Ant1	5720	-36.52	6.56	-29.96	Peak	15.6	Pass
NVNT	be80	5775	Ant1	5720	-46.51	6.56	-39.95	Average	15.6	Pass
NVNT	be80	5775	Ant1	5725	-41.09	6.56	-34.53	Peak	27	Pass
NVNT	be80	5775	Ant1	5725	-47.17	6.56	-40.61	Average	27	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

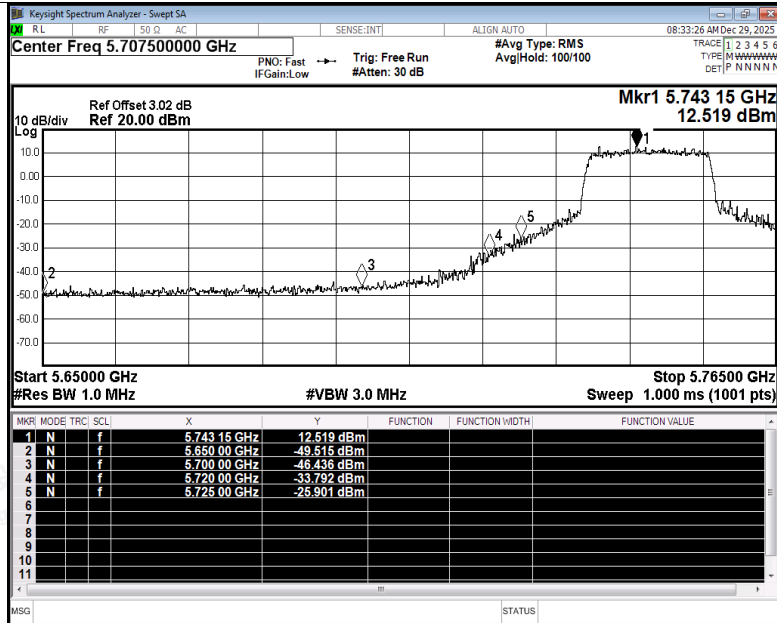

Restrict Band NVNT a 5745MHz Ant1 Peak

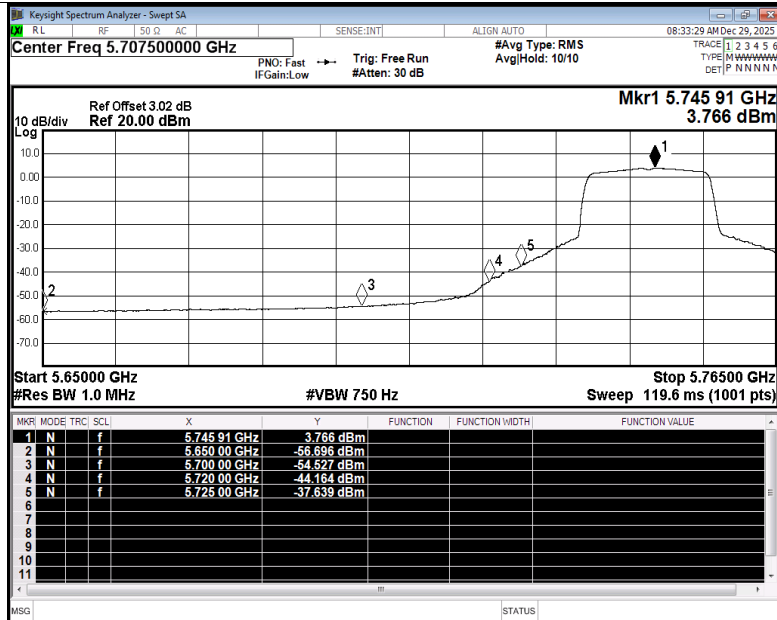

Restrict Band NVNT a 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

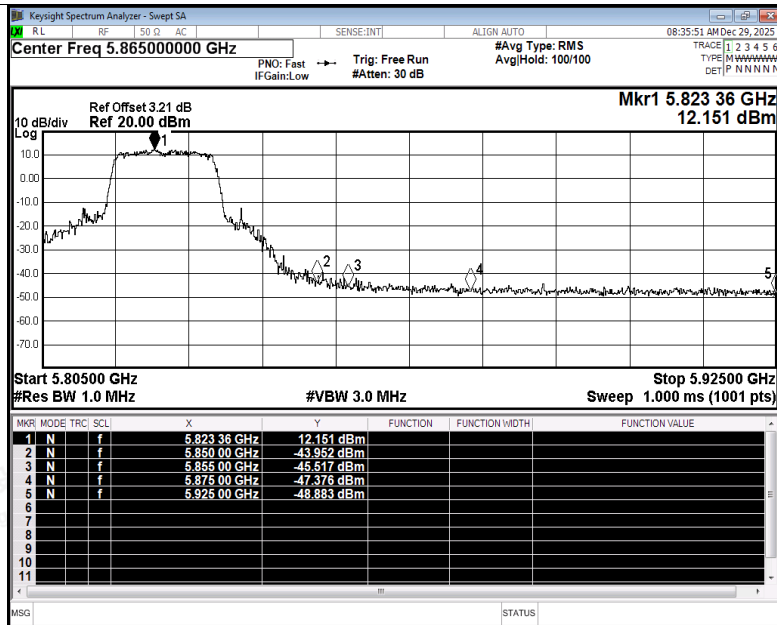

Restrict Band NVNT a 5825MHz Ant1 Peak

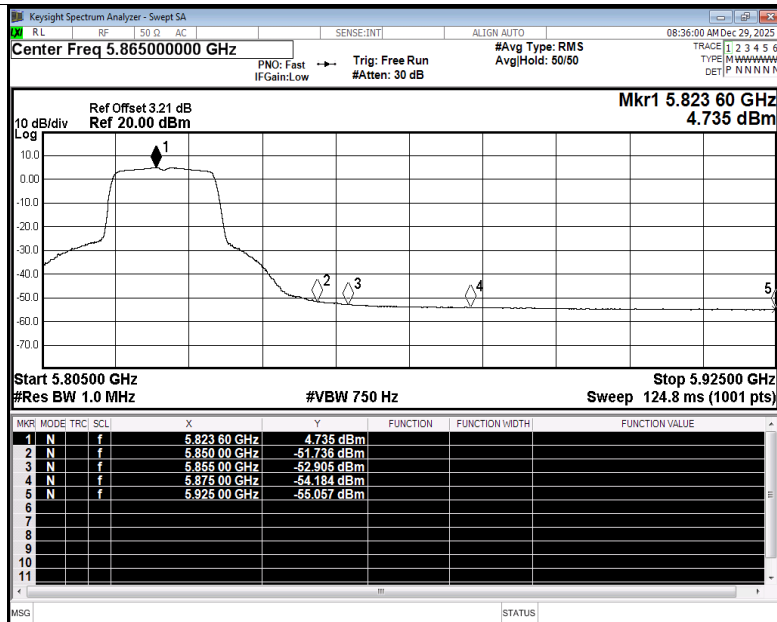

Restrict Band NVNT a 5825MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

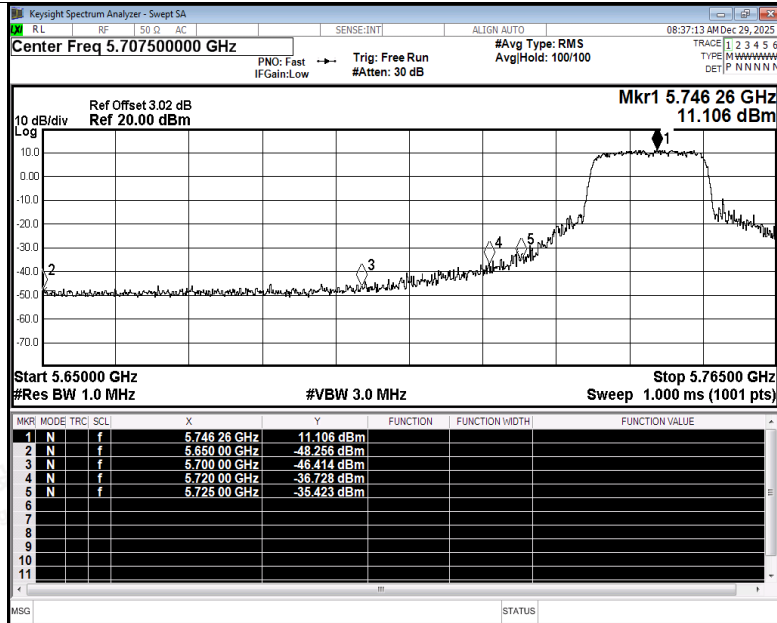

Restrict Band NVNT n20 5745MHz Ant1 Peak

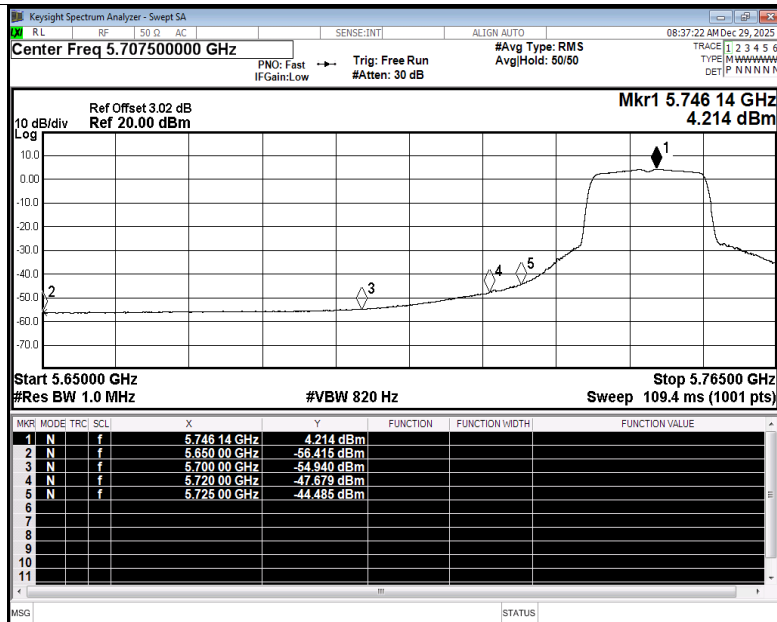

Restrict Band NVNT n20 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

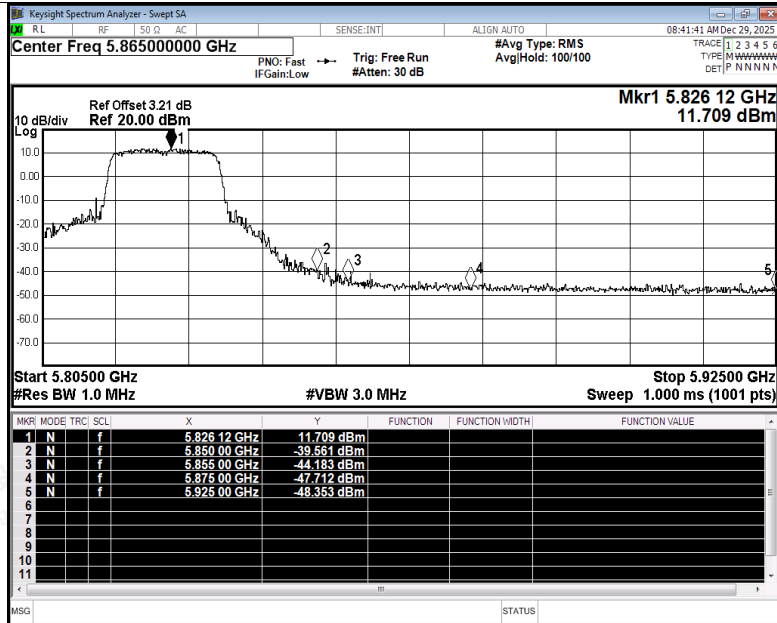

Restrict Band NVNT n20 5825MHz Ant1 Peak

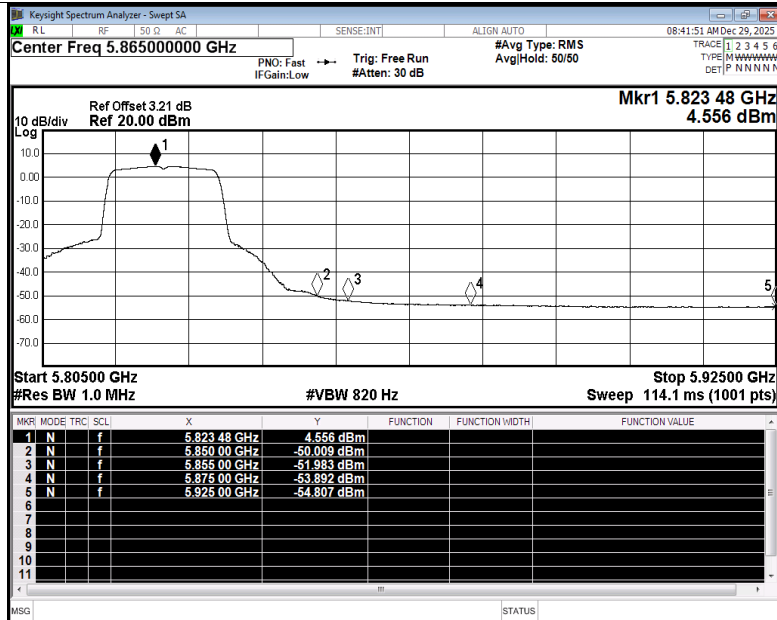

Restrict Band NVNT n20 5825MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

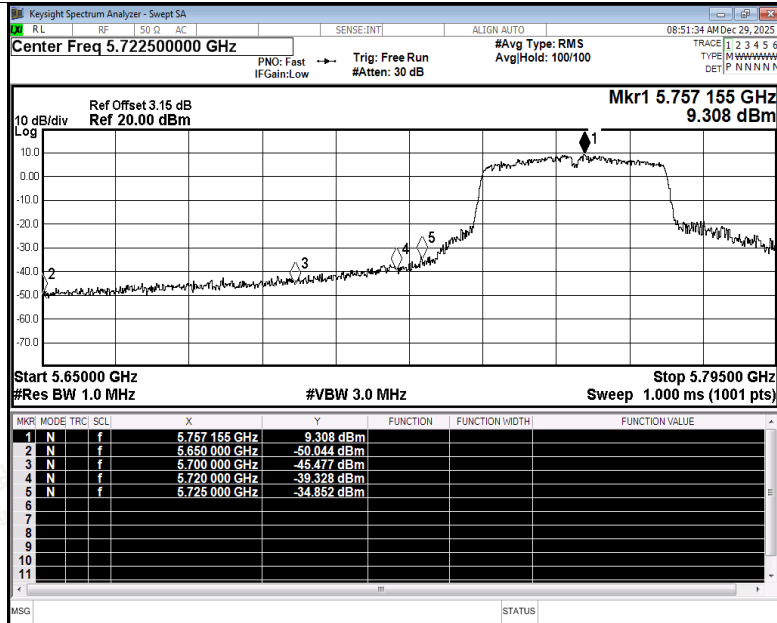

Restrict Band NVNT n40 5755MHz Ant1 Peak

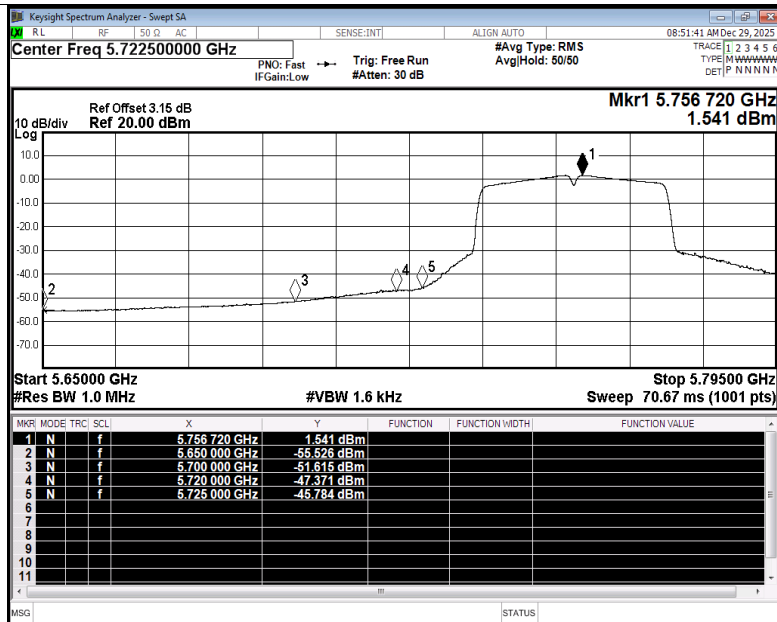

Restrict Band NVNT n40 5755MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

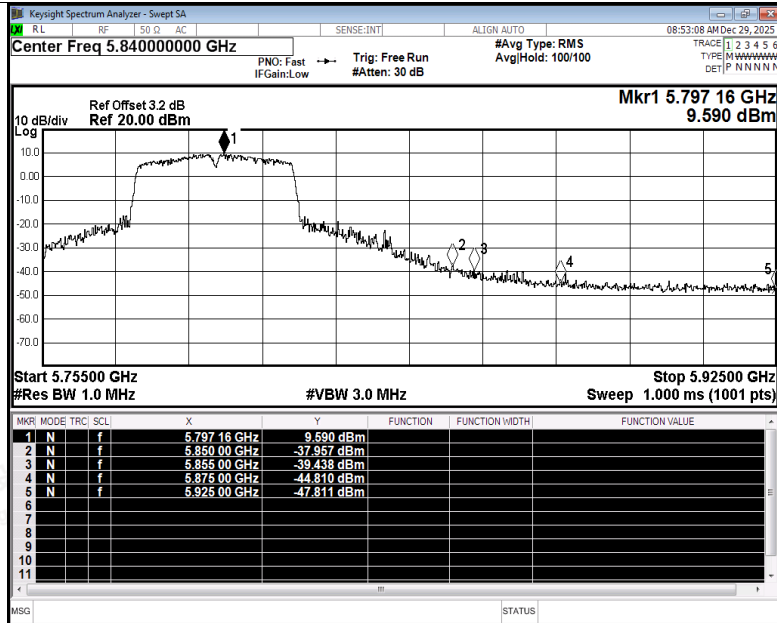

Restrict Band NVNT n40 5795MHz Ant1 Peak

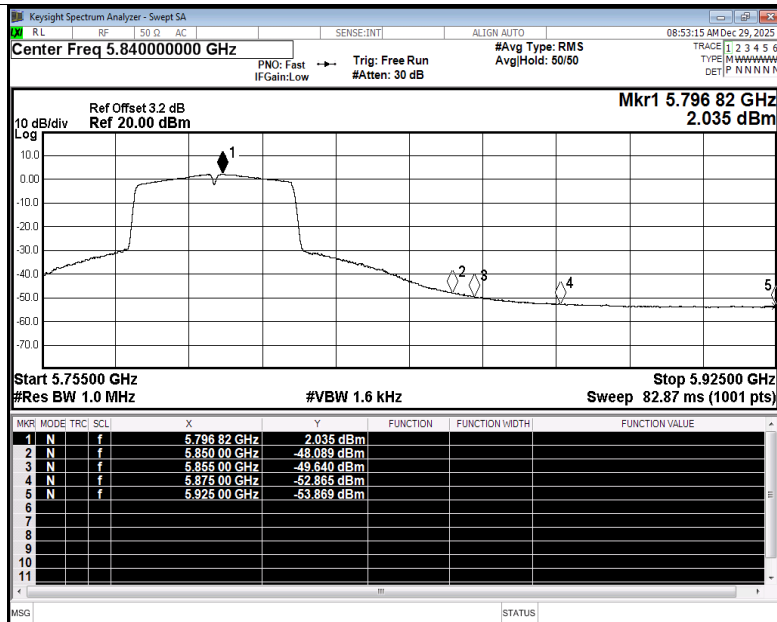

Restrict Band NVNT n40 5795MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

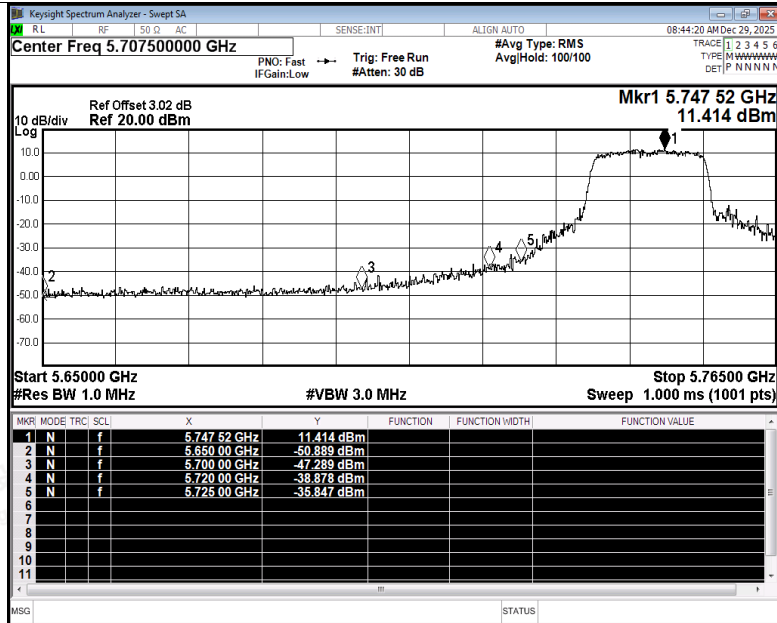

Restrict Band NVNT ac20 5745MHz Ant1 Peak

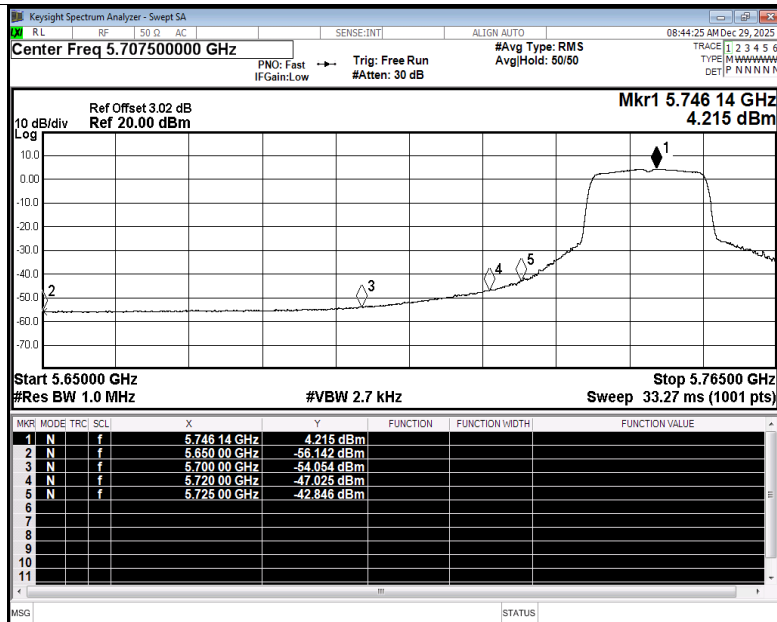

Restrict Band NVNT ac20 5745MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity