





Restrict Band NVNT ac20 5825MHz Ant1 Peak

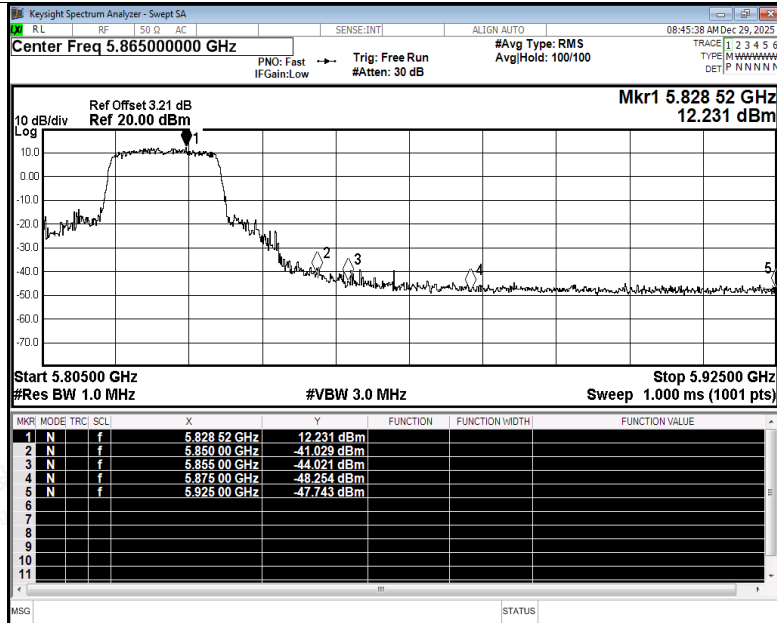

Restrict Band NVNT ac20 5825MHz Ant1 Average

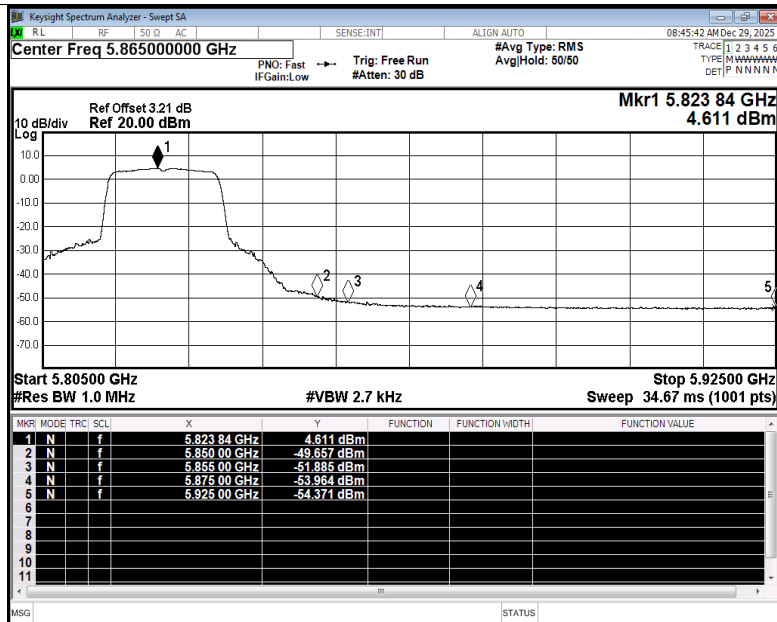


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

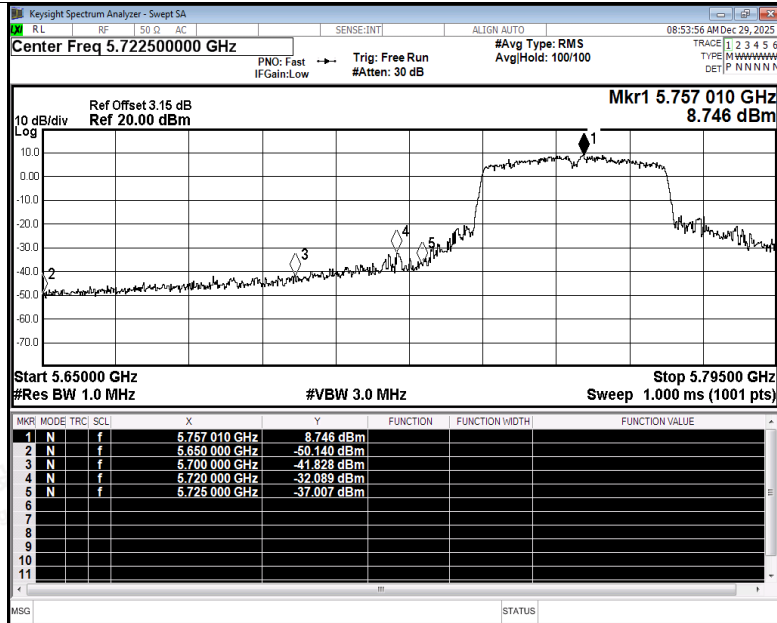

Restrict Band NVNT ac40 5755MHz Ant1 Peak

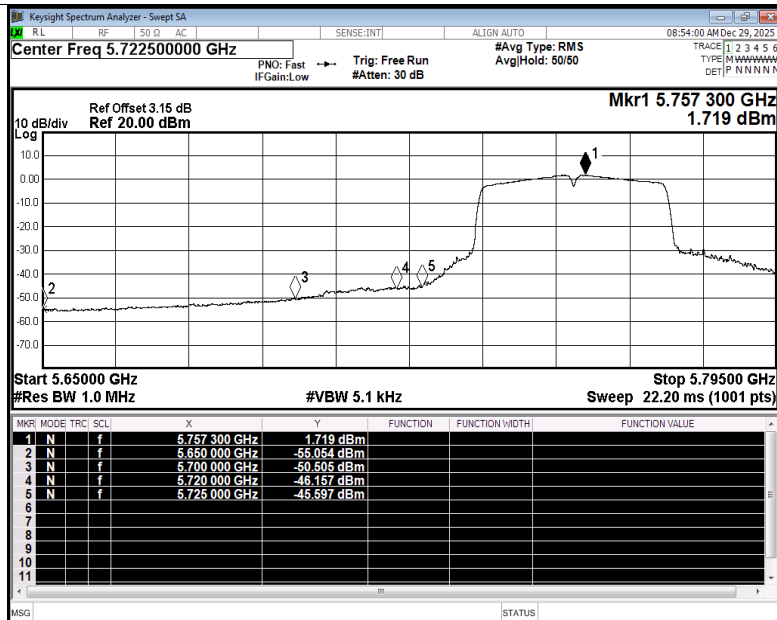

Restrict Band NVNT ac40 5755MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

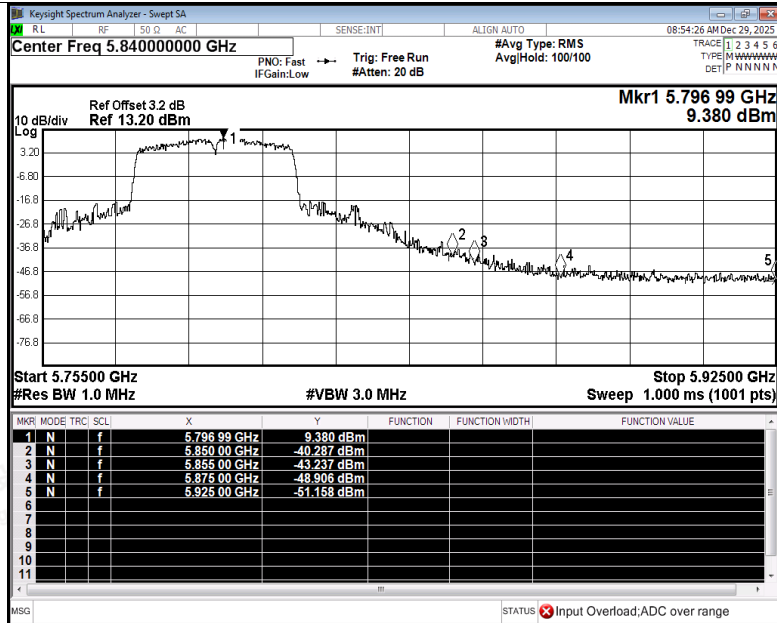

Restrict Band NVNT ac40 5795MHz Ant1 Peak

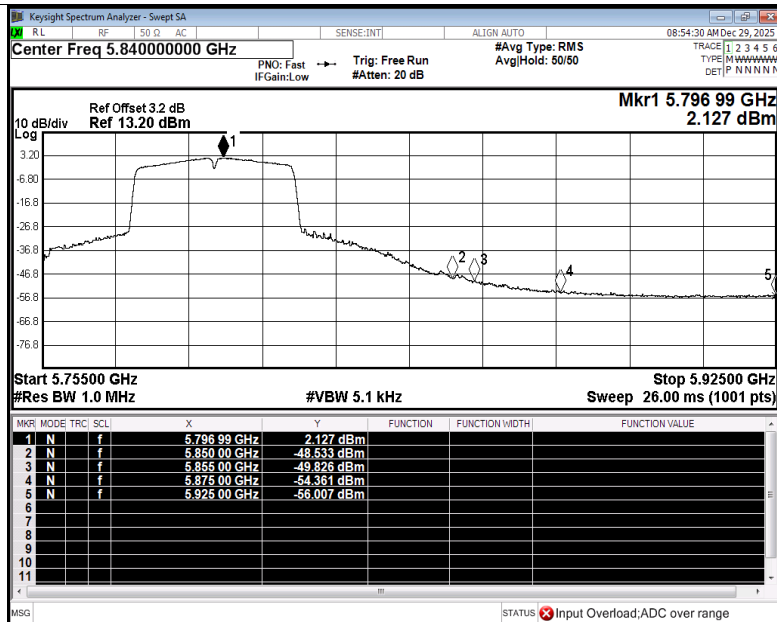

Restrict Band NVNT ac40 5795MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

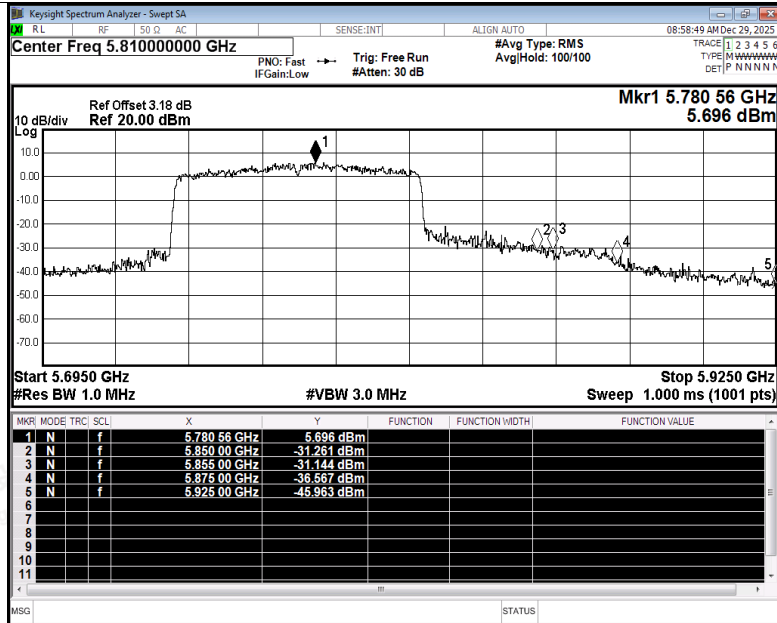

Restrict Band NVNT ac80 5775MHz Ant1 Peak

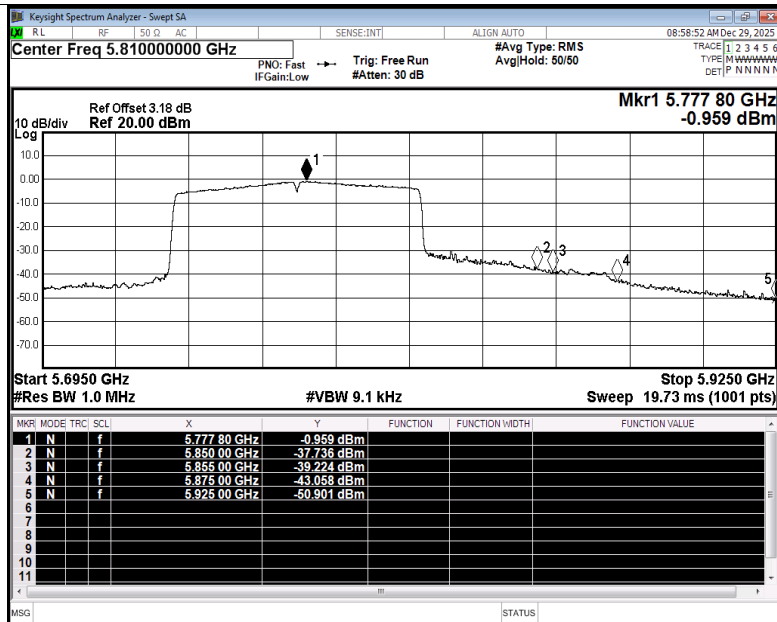

Restrict Band NVNT ac80 5775MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

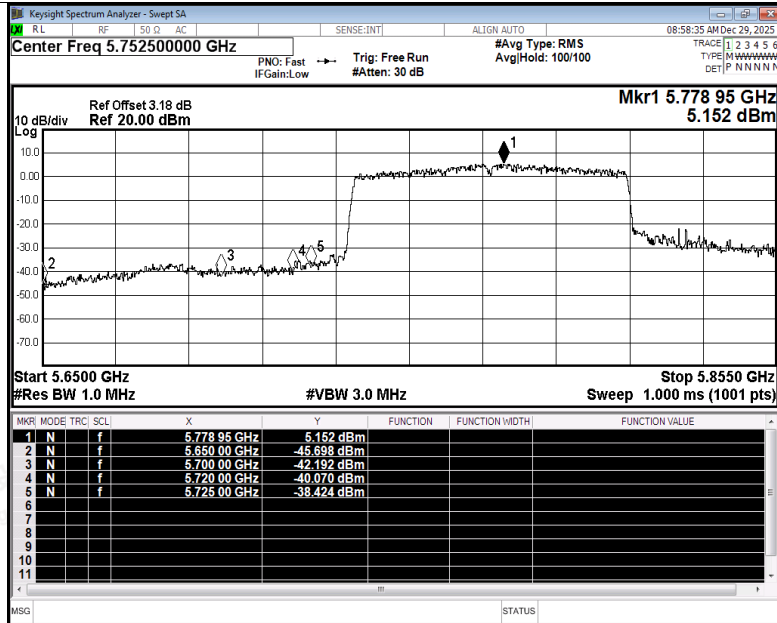

Restrict Band NVNT ac80 5775MHz Ant1 Peak

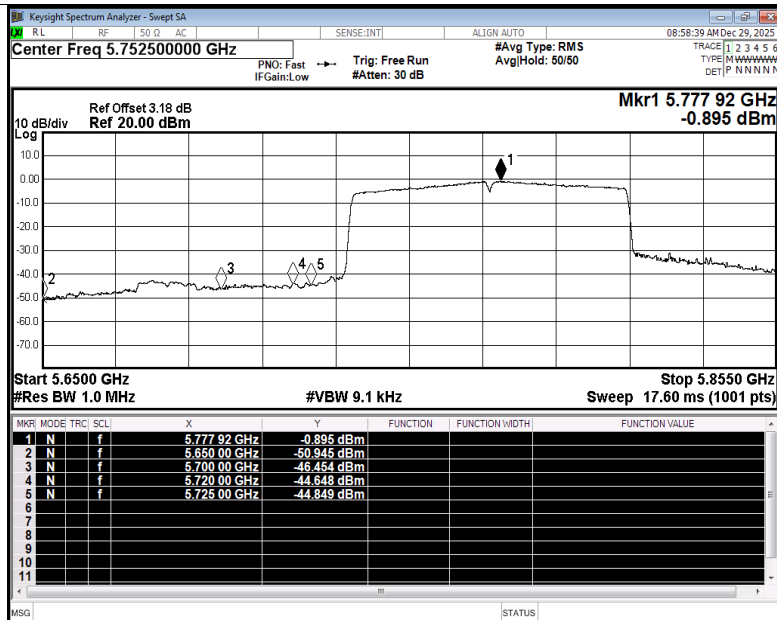

Restrict Band NVNT ac80 5775MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

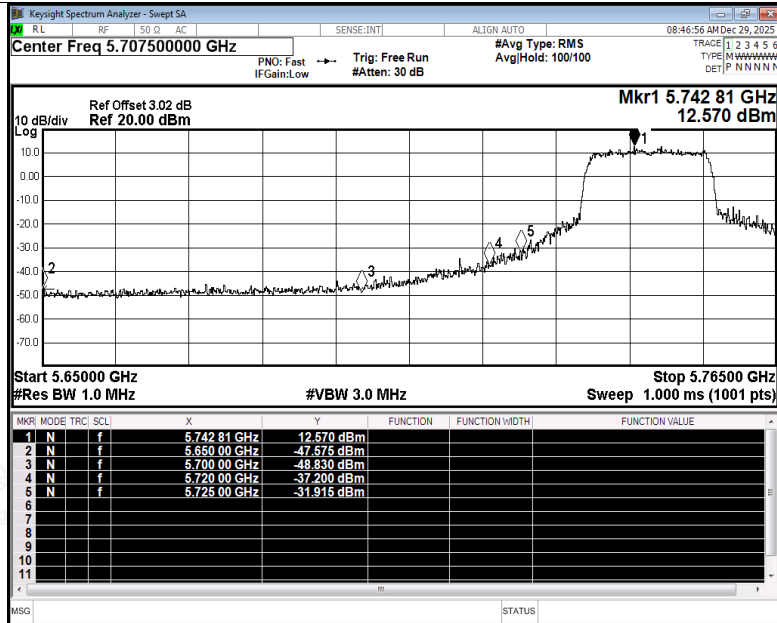

Restrict Band NVNT ax20 5745MHz Ant1 Peak

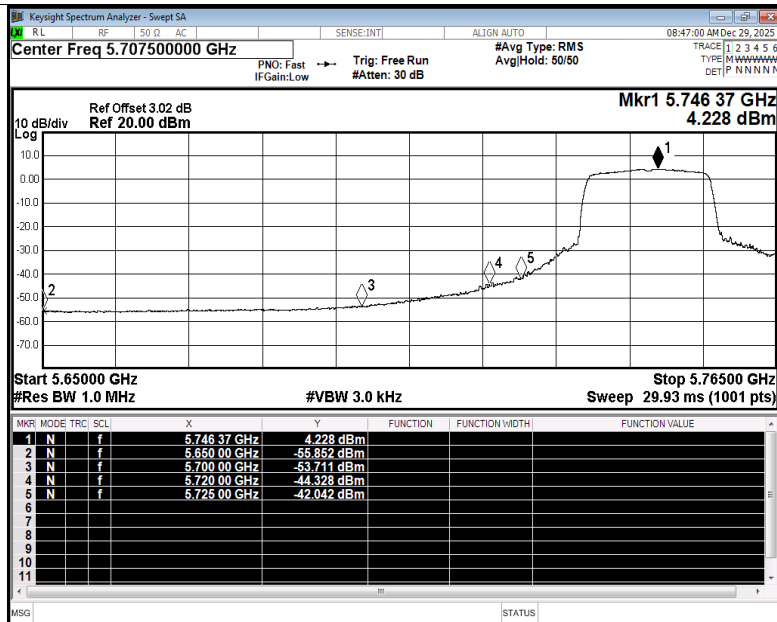

Restrict Band NVNT ax20 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

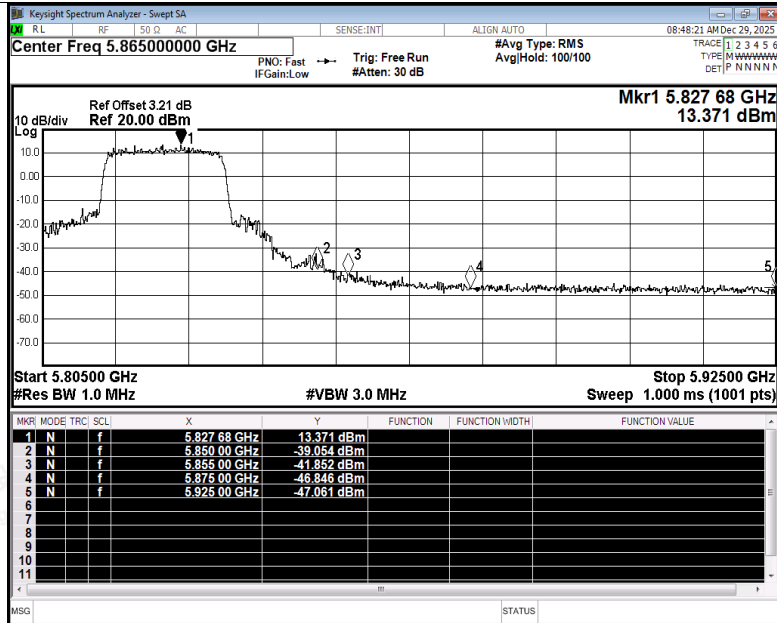

Restrict Band NVNT ax20 5825MHz Ant1 Peak

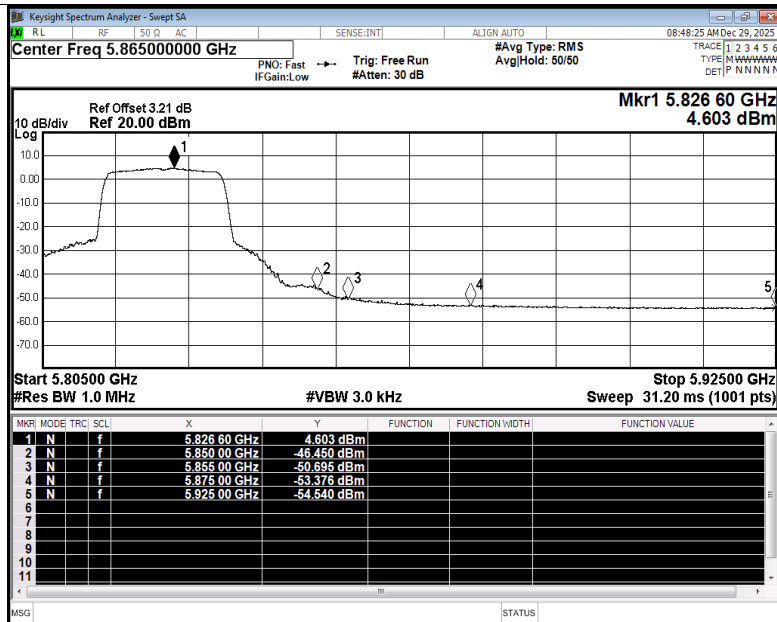

Restrict Band NVNT ax20 5825MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

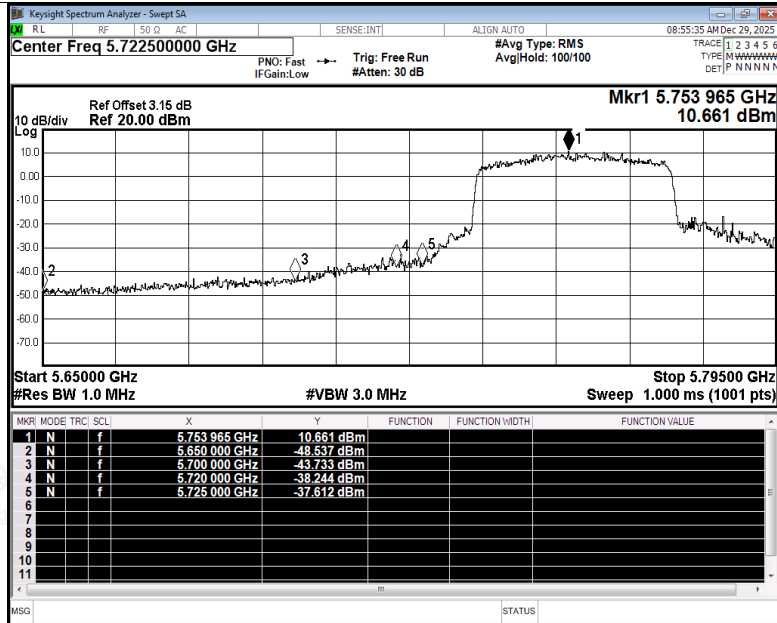

Restrict Band NVNT ax40 5755MHz Ant1 Peak

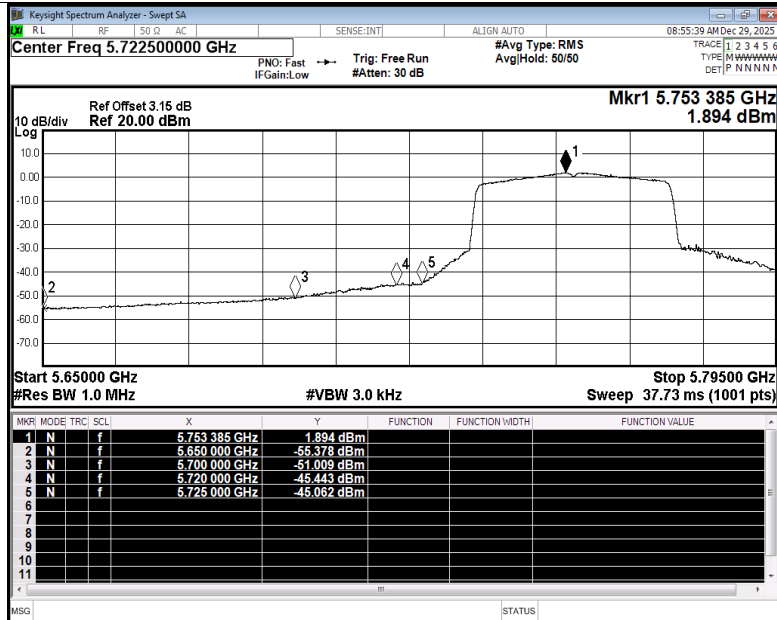

Restrict Band NVNT ax40 5755MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

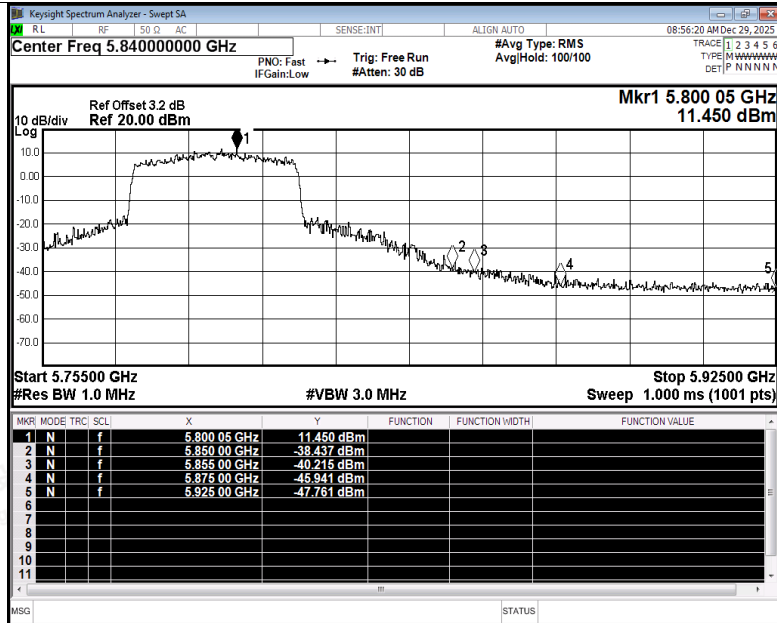

Restrict Band NVNT ax40 5795MHz Ant1 Peak

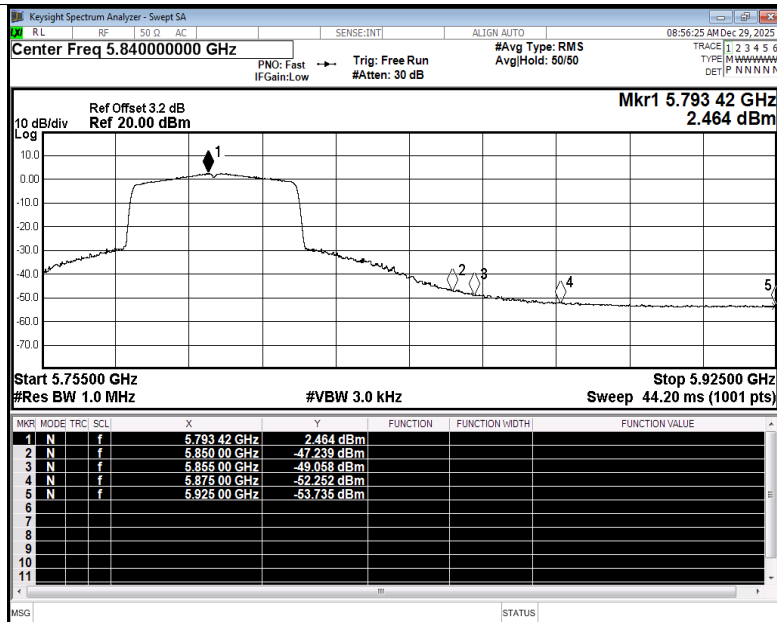

Restrict Band NVNT ax40 5795MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

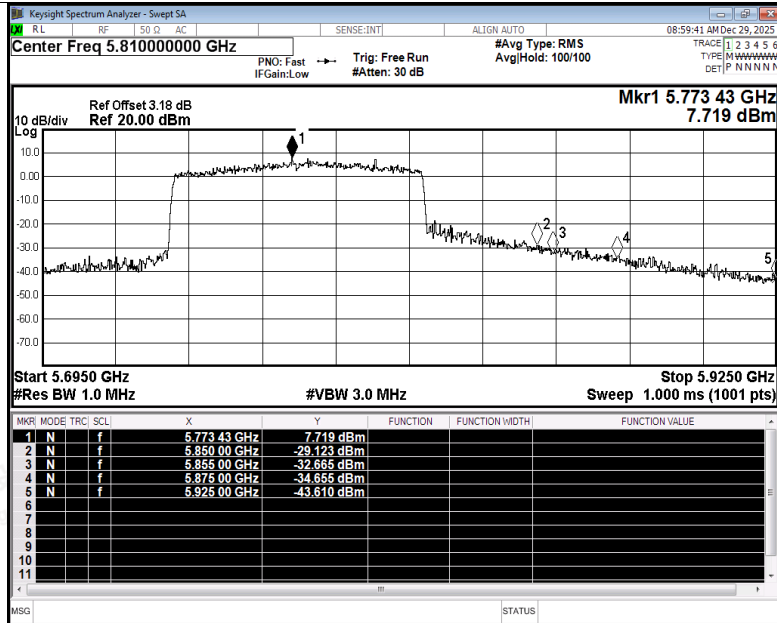

Restrict Band NVNT ax80 5775MHz Ant1 Peak

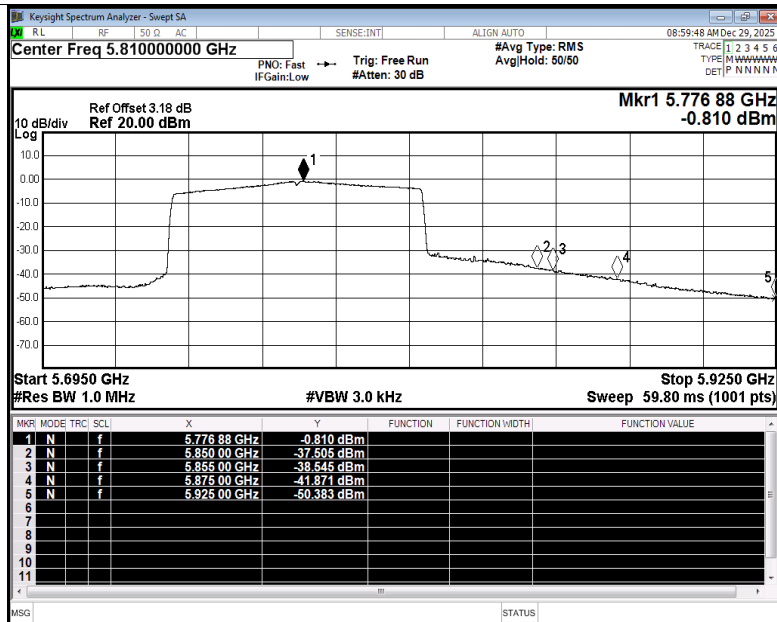

Restrict Band NVNT ax80 5775MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

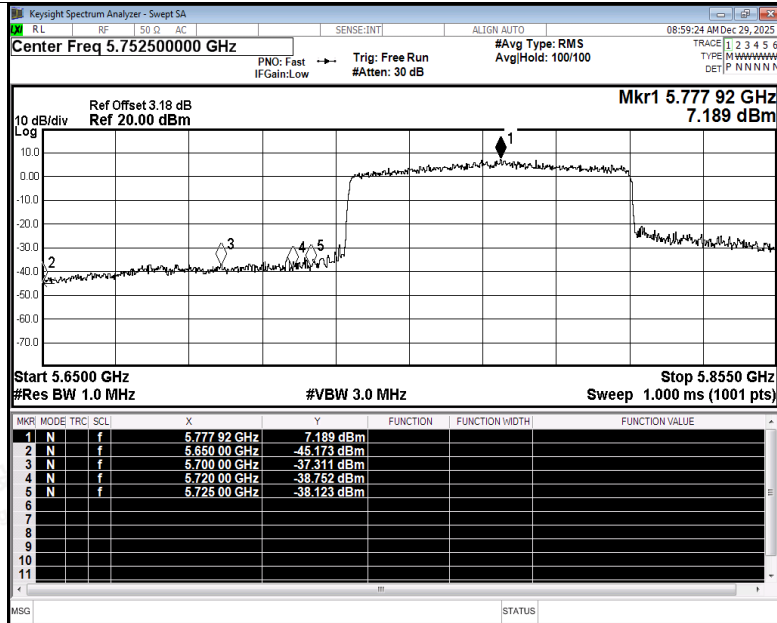

Restrict Band NVNT ax80 5775MHz Ant1 Peak

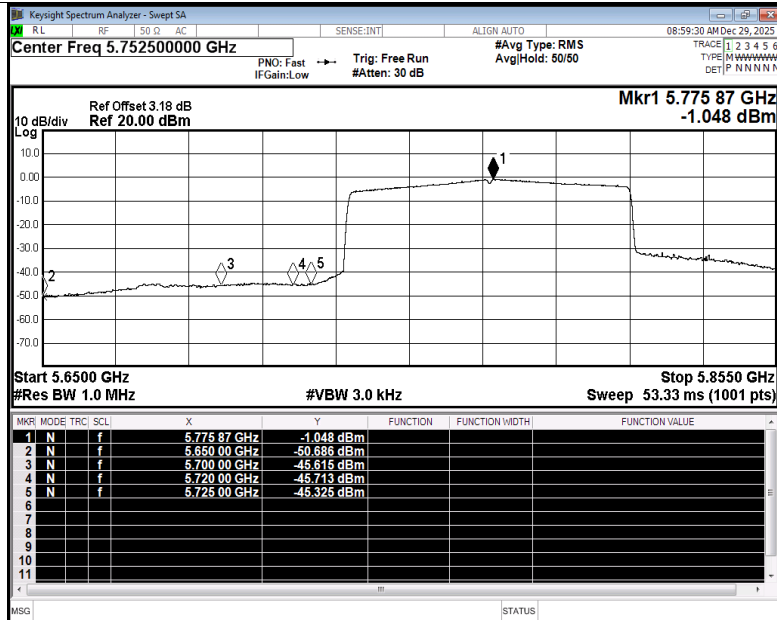

Restrict Band NVNT ax80 5775MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

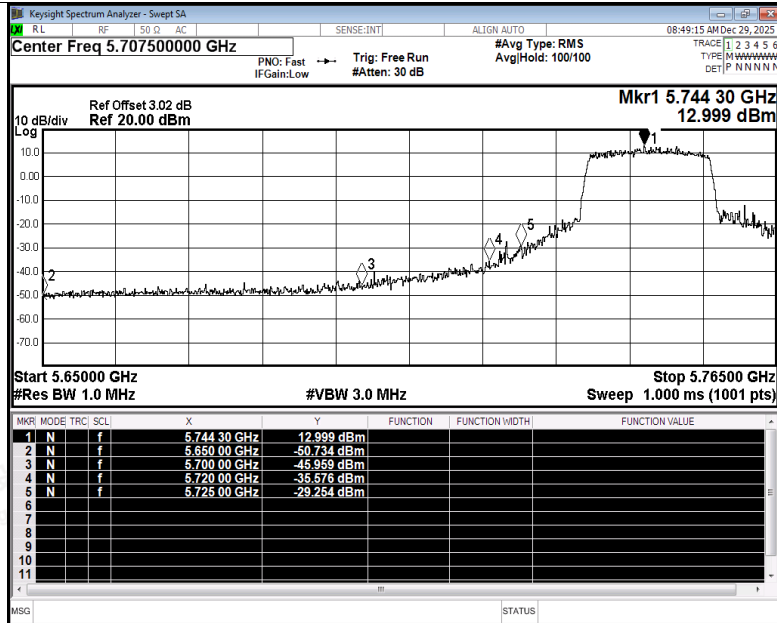

Restrict Band NVNT be20 5745MHz Ant1 Peak

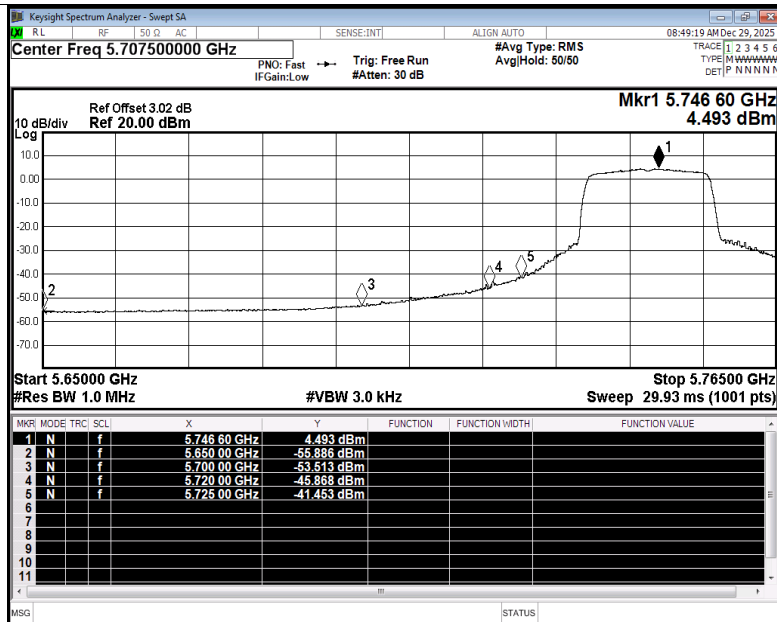

Restrict Band NVNT be20 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

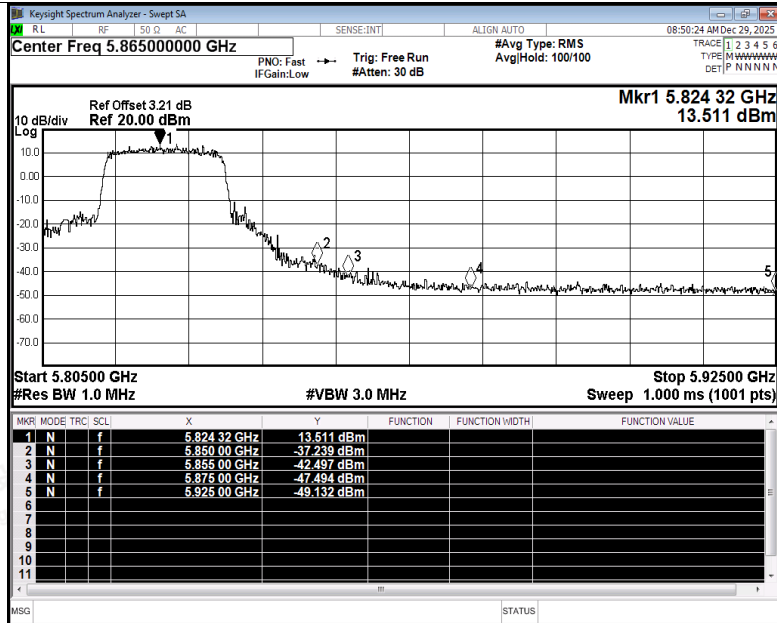

Restrict Band NVNT be20 5825MHz Ant1 Peak

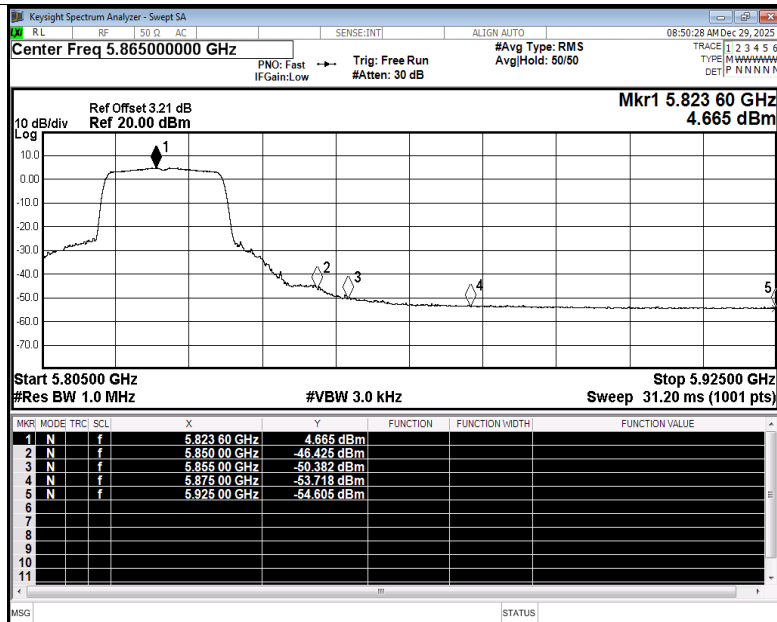

Restrict Band NVNT be20 5825MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

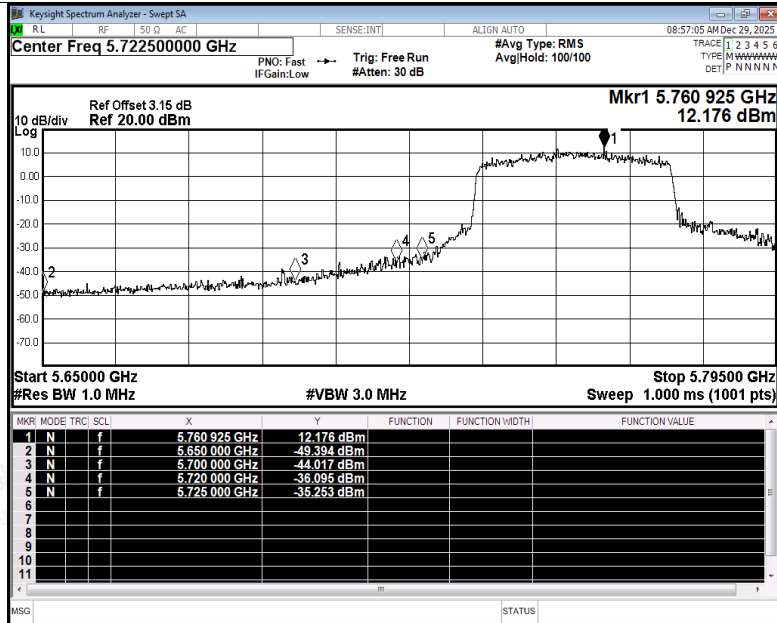

Restrict Band NVNT be40 5755MHz Ant1 Peak

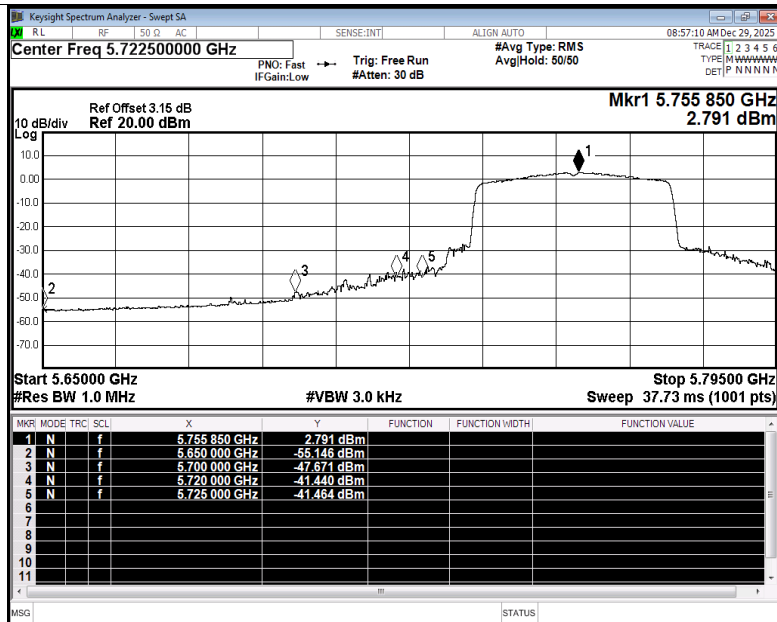

Restrict Band NVNT be40 5755MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

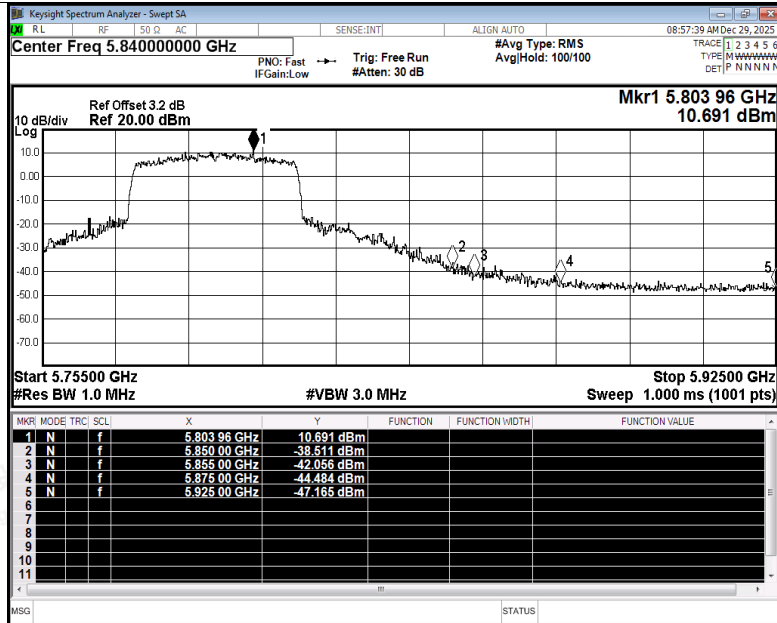

Restrict Band NVNT be40 5795MHz Ant1 Peak

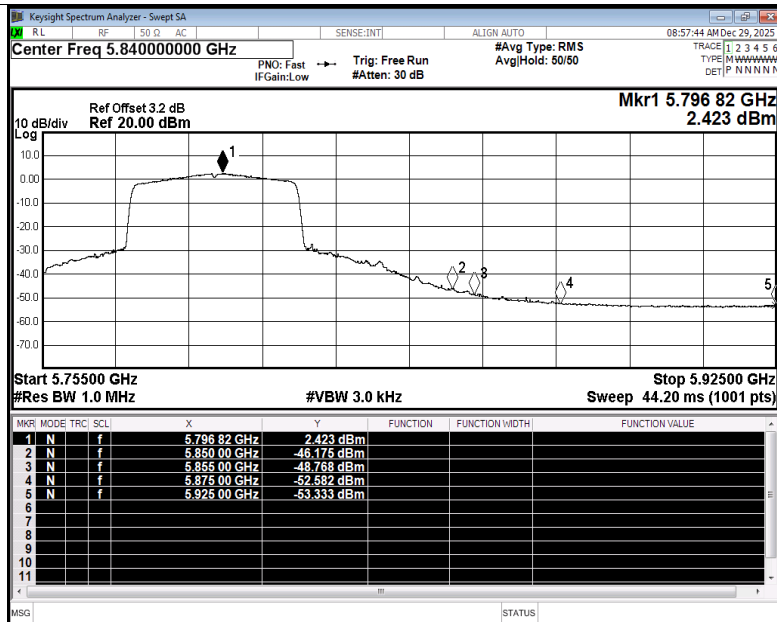

Restrict Band NVNT be40 5795MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

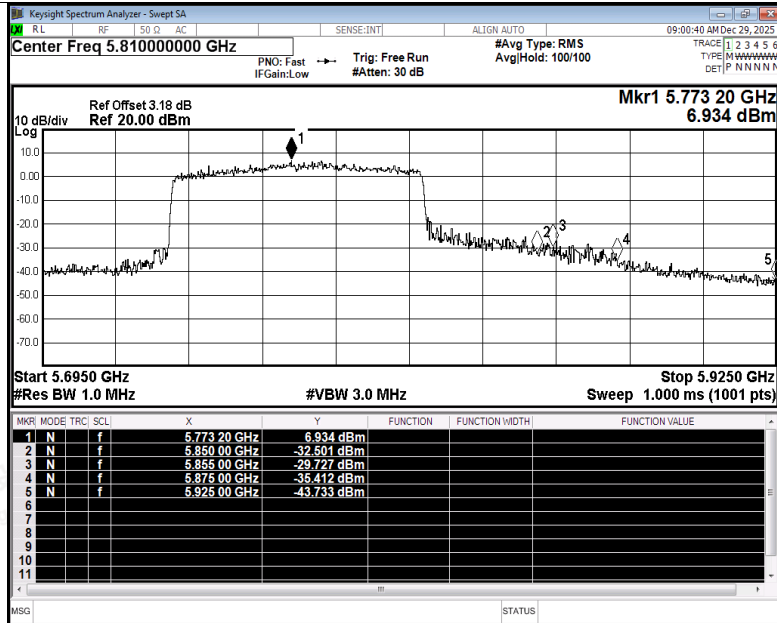

Restrict Band NVNT be80 5775MHz Ant1 Peak

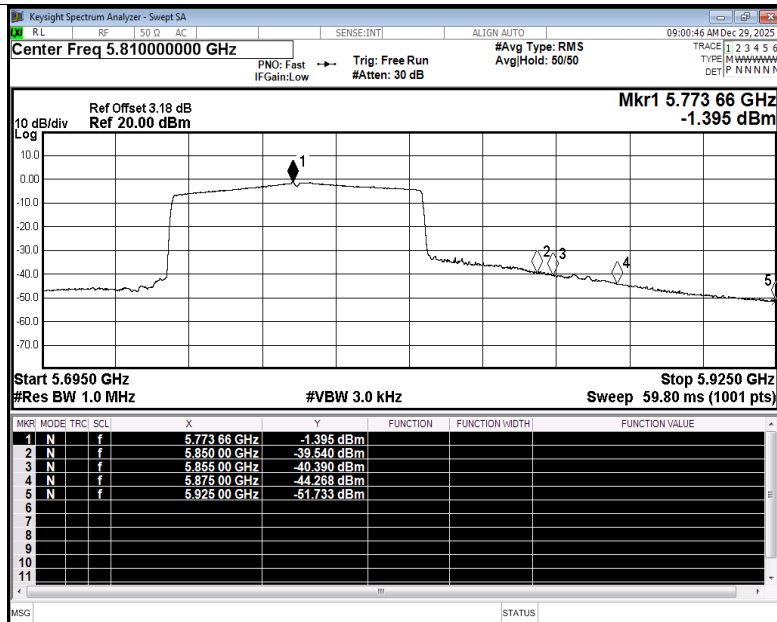

Restrict Band NVNT be80 5775MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

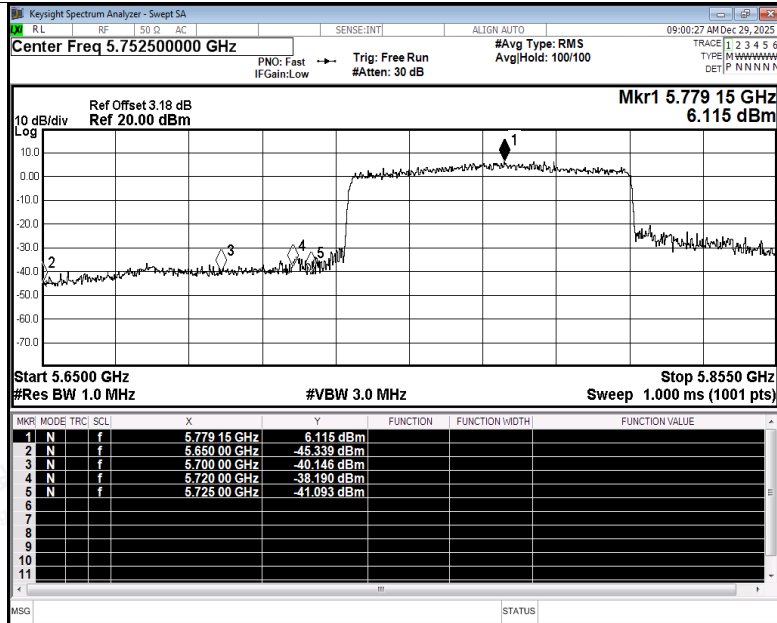

Restrict Band NVNT be80 5775MHz Ant1 Peak

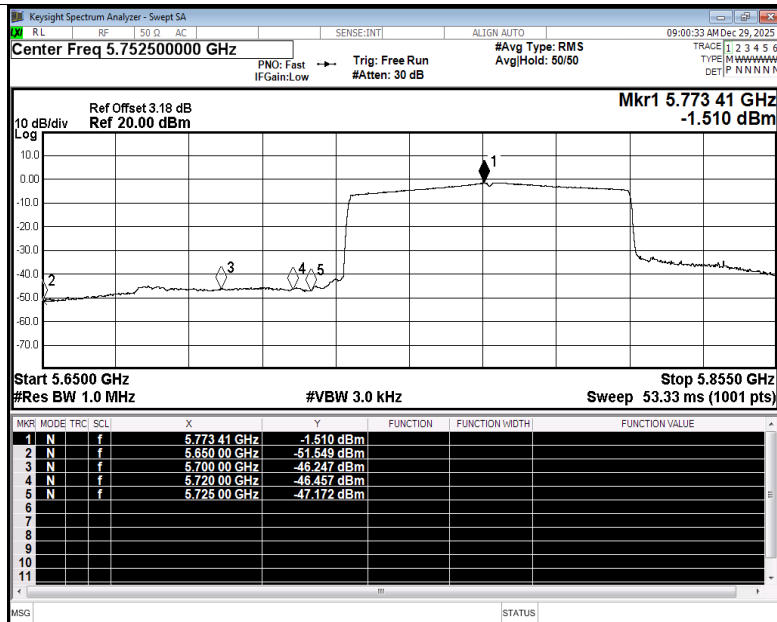

Restrict Band NVNT be80 5775MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	EIRP (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant2	5650	-50.56	6.56	-44	Peak	-27	Pass
NVNT	a	5745	Ant2	5650	-57.34	6.56	-50.78	Average	-27	Pass
NVNT	a	5745	Ant2	5700	-40.04	6.56	-33.48	Peak	10	Pass
NVNT	a	5745	Ant2	5700	-50.14	6.56	-43.58	Average	10	Pass
NVNT	a	5745	Ant2	5720	-29.09	6.56	-22.53	Peak	15.6	Pass
NVNT	a	5745	Ant2	5720	-38.32	6.56	-31.76	Average	15.6	Pass
NVNT	a	5745	Ant2	5725	-19.37	6.56	-12.81	Peak	27	Pass
NVNT	a	5745	Ant2	5725	-28.56	6.56	-22	Average	27	Pass
NVNT	a	5825	Ant2	5850	-24.65	6.56	-18.09	Peak	27	Pass
NVNT	a	5825	Ant2	5850	-34.4	6.56	-27.84	Average	27	Pass
NVNT	a	5825	Ant2	5855	-29.35	6.56	-22.79	Peak	15.6	Pass
NVNT	a	5825	Ant2	5855	-39.05	6.56	-32.49	Average	15.6	Pass
NVNT	a	5825	Ant2	5875	-38.26	6.56	-31.7	Peak	10	Pass
NVNT	a	5825	Ant2	5875	-48.89	6.56	-42.33	Average	10	Pass
NVNT	a	5825	Ant2	5925	-49.28	6.56	-42.72	Peak	-27	Pass
NVNT	a	5825	Ant2	5925	-56.46	6.56	-49.9	Average	-27	Pass
NVNT	n20	5745	Ant2	5650	-51.67	6.56	-45.11	Peak	-27	Pass
NVNT	n20	5745	Ant2	5650	-57.34	6.56	-50.78	Average	-27	Pass
NVNT	n20	5745	Ant2	5700	-42.16	6.56	-35.6	Peak	10	Pass
NVNT	n20	5745	Ant2	5700	-49.83	6.56	-43.27	Average	10	Pass
NVNT	n20	5745	Ant2	5720	-30.12	6.56	-23.56	Peak	15.6	Pass
NVNT	n20	5745	Ant2	5720	-38.2	6.56	-31.64	Average	15.6	Pass
NVNT	n20	5745	Ant2	5725	-19.39	6.56	-12.83	Peak	27	Pass
NVNT	n20	5745	Ant2	5725	-29.01	6.56	-22.45	Average	27	Pass
NVNT	n20	5825	Ant2	5850	-24.6	6.56	-18.04	Peak	27	Pass
NVNT	n20	5825	Ant2	5850	-33.79	6.56	-27.23	Average	27	Pass
NVNT	n20	5825	Ant2	5855	-29.33	6.56	-22.77	Peak	15.6	Pass
NVNT	n20	5825	Ant2	5855	-38.36	6.56	-31.8	Average	15.6	Pass
NVNT	n20	5825	Ant2	5875	-41.22	6.56	-34.66	Peak	10	Pass
NVNT	n20	5825	Ant2	5875	-48.58	6.56	-42.02	Average	10	Pass
NVNT	n20	5825	Ant2	5925	-48.6	6.56	-42.04	Peak	-27	Pass
NVNT	n20	5825	Ant2	5925	-56.37	6.56	-49.81	Average	-27	Pass
NVNT	n40	5755	Ant2	5650	-45.57	6.56	-39.01	Peak	-27	Pass
NVNT	n40	5755	Ant2	5650	-53.25	6.56	-46.69	Average	-27	Pass
NVNT	n40	5755	Ant2	5700	-35.29	6.56	-28.73	Peak	10	Pass
NVNT	n40	5755	Ant2	5700	-44.31	6.56	-37.75	Average	10	Pass
NVNT	n40	5755	Ant2	5720	-18.97	6.56	-12.41	Peak	15.6	Pass
NVNT	n40	5755	Ant2	5720	-28.8	6.56	-22.24	Average	15.6	Pass
NVNT	n40	5755	Ant2	5725	-19.7	6.56	-13.14	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant2	5725	-26.62	6.56	-20.06	Average	27	Pass
NVNT	n40	5795	Ant2	5850	-27.61	6.56	-21.05	Peak	27	Pass
NVNT	n40	5795	Ant2	5850	-36.55	6.56	-29.99	Average	27	Pass
NVNT	n40	5795	Ant2	5855	-28.61	6.56	-22.05	Peak	15.6	Pass
NVNT	n40	5795	Ant2	5855	-37.78	6.56	-31.22	Average	15.6	Pass
NVNT	n40	5795	Ant2	5875	-34.07	6.56	-27.51	Peak	10	Pass
NVNT	n40	5795	Ant2	5875	-43.13	6.56	-36.57	Average	10	Pass
NVNT	n40	5795	Ant2	5925	-45.24	6.56	-38.68	Peak	-27	Pass
NVNT	n40	5795	Ant2	5925	-53.96	6.56	-47.4	Average	-27	Pass
NVNT	ac20	5745	Ant2	5650	-48.07	6.56	-41.51	Peak	-27	Pass
NVNT	ac20	5745	Ant2	5650	-57.01	6.56	-50.45	Average	-27	Pass
NVNT	ac20	5745	Ant2	5700	-38.06	6.56	-31.5	Peak	10	Pass
NVNT	ac20	5745	Ant2	5700	-48.13	6.56	-41.57	Average	10	Pass
NVNT	ac20	5745	Ant2	5720	-26.91	6.56	-20.35	Peak	15.6	Pass
NVNT	ac20	5745	Ant2	5720	-34.08	6.56	-27.52	Average	15.6	Pass
NVNT	ac20	5745	Ant2	5725	-17.72	6.56	-11.16	Peak	27	Pass
NVNT	ac20	5745	Ant2	5725	-25.29	6.56	-18.73	Average	27	Pass
NVNT	ac20	5825	Ant2	5850	-22.48	6.56	-15.92	Peak	27	Pass
NVNT	ac20	5825	Ant2	5850	-30.97	6.56	-24.41	Average	27	Pass
NVNT	ac20	5825	Ant2	5855	-29	6.56	-22.44	Peak	15.6	Pass
NVNT	ac20	5825	Ant2	5855	-34.9	6.56	-28.34	Average	15.6	Pass
NVNT	ac20	5825	Ant2	5875	-35.5	6.56	-28.94	Peak	10	Pass
NVNT	ac20	5825	Ant2	5875	-45.32	6.56	-38.76	Average	10	Pass
NVNT	ac20	5825	Ant2	5925	-47.05	6.56	-40.49	Peak	-27	Pass
NVNT	ac20	5825	Ant2	5925	-55.84	6.56	-49.28	Average	-27	Pass
NVNT	ac40	5755	Ant2	5650	-44.79	6.56	-38.23	Peak	-27	Pass
NVNT	ac40	5755	Ant2	5650	-50.66	6.56	-44.1	Average	-27	Pass
NVNT	ac40	5755	Ant2	5700	-26.48	6.56	-19.92	Peak	10	Pass
NVNT	ac40	5755	Ant2	5700	-38.75	6.56	-32.19	Average	10	Pass
NVNT	ac40	5755	Ant2	5720	-18.85	6.56	-12.29	Peak	15.6	Pass
NVNT	ac40	5755	Ant2	5720	-24.96	6.56	-18.4	Average	15.6	Pass
NVNT	ac40	5755	Ant2	5725	-14.27	6.56	-7.71	Peak	27	Pass
NVNT	ac40	5755	Ant2	5725	-23.05	6.56	-16.49	Average	27	Pass
NVNT	ac40	5795	Ant2	5850	-25.71	6.56	-19.15	Peak	27	Pass
NVNT	ac40	5795	Ant2	5850	-32.69	6.56	-26.13	Average	27	Pass
NVNT	ac40	5795	Ant2	5855	-28.31	6.56	-21.75	Peak	15.6	Pass
NVNT	ac40	5795	Ant2	5855	-34.4	6.56	-27.84	Average	15.6	Pass
NVNT	ac40	5795	Ant2	5875	-34.42	6.56	-27.86	Peak	10	Pass
NVNT	ac40	5795	Ant2	5875	-40.62	6.56	-34.06	Average	10	Pass
NVNT	ac40	5795	Ant2	5925	-41.31	6.56	-34.75	Peak	-27	Pass
NVNT	ac40	5795	Ant2	5925	-51.26	6.56	-44.7	Average	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	Ant2	5850	-19.2	6.56	-12.64	Peak	27	Pass
NVNT	ac80	5775	Ant2	5850	-24.68	6.56	-18.12	Average	27	Pass
NVNT	ac80	5775	Ant2	5855	-21.3	6.56	-14.74	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5855	-26.03	6.56	-19.47	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5875	-26.11	6.56	-19.55	Peak	10	Pass
NVNT	ac80	5775	Ant2	5875	-32.84	6.56	-26.28	Average	10	Pass
NVNT	ac80	5775	Ant2	5925	-37.89	6.56	-31.33	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5925	-41.57	6.56	-35.01	Average	-27	Pass
NVNT	ac80	5775	Ant2	5650	-39.99	6.56	-33.43	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5650	-46.09	6.56	-39.53	Average	-27	Pass
NVNT	ac80	5775	Ant2	5700	-24.82	6.56	-18.26	Peak	10	Pass
NVNT	ac80	5775	Ant2	5700	-30.17	6.56	-23.61	Average	10	Pass
NVNT	ac80	5775	Ant2	5720	-16.77	6.56	-10.21	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5720	-25.75	6.56	-19.19	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5725	-20.08	6.56	-13.52	Peak	27	Pass
NVNT	ac80	5775	Ant2	5725	-25.43	6.56	-18.87	Average	27	Pass
NVNT	ax20	5745	Ant2	5650	-49.23	6.56	-42.67	Peak	-27	Pass
NVNT	ax20	5745	Ant2	5650	-56.42	6.56	-49.86	Average	-27	Pass
NVNT	ax20	5745	Ant2	5700	-38.7	6.56	-32.14	Peak	10	Pass
NVNT	ax20	5745	Ant2	5700	-46.16	6.56	-39.6	Average	10	Pass
NVNT	ax20	5745	Ant2	5720	-16.33	6.56	-9.77	Peak	15.6	Pass
NVNT	ax20	5745	Ant2	5720	-28.77	6.56	-22.21	Average	15.6	Pass
NVNT	ax20	5745	Ant2	5725	-14.9	6.56	-8.34	Peak	27	Pass
NVNT	ax20	5745	Ant2	5725	-23.54	6.56	-16.98	Average	27	Pass
NVNT	ax20	5825	Ant2	5850	-18.2	6.56	-11.64	Peak	27	Pass
NVNT	ax20	5825	Ant2	5850	-27.18	6.56	-20.62	Average	27	Pass
NVNT	ax20	5825	Ant2	5855	-27.92	6.56	-21.36	Peak	15.6	Pass
NVNT	ax20	5825	Ant2	5855	-33.75	6.56	-27.19	Average	15.6	Pass
NVNT	ax20	5825	Ant2	5875	-28.99	6.56	-22.43	Peak	10	Pass
NVNT	ax20	5825	Ant2	5875	-43.13	6.56	-36.57	Average	10	Pass
NVNT	ax20	5825	Ant2	5925	-49.57	6.56	-43.01	Peak	-27	Pass
NVNT	ax20	5825	Ant2	5925	-55.34	6.56	-48.78	Average	-27	Pass
NVNT	ax40	5755	Ant2	5650	-43.3	6.56	-36.74	Peak	-27	Pass
NVNT	ax40	5755	Ant2	5650	-49.32	6.56	-42.76	Average	-27	Pass
NVNT	ax40	5755	Ant2	5700	-31.56	6.56	-25	Peak	10	Pass
NVNT	ax40	5755	Ant2	5700	-38.23	6.56	-31.67	Average	10	Pass
NVNT	ax40	5755	Ant2	5720	-15.48	6.56	-8.92	Peak	15.6	Pass
NVNT	ax40	5755	Ant2	5720	-24.02	6.56	-17.46	Average	15.6	Pass
NVNT	ax40	5755	Ant2	5725	-15.64	6.56	-9.08	Peak	27	Pass
NVNT	ax40	5755	Ant2	5725	-22.21	6.56	-15.65	Average	27	Pass
NVNT	ax40	5795	Ant2	5850	-26.22	6.56	-19.66	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5795	Ant2	5850	-33.33	6.56	-26.77	Average	27	Pass
NVNT	ax40	5795	Ant2	5855	-28.65	6.56	-22.09	Peak	15.6	Pass
NVNT	ax40	5795	Ant2	5855	-35.79	6.56	-29.23	Average	15.6	Pass
NVNT	ax40	5795	Ant2	5875	-33.85	6.56	-27.29	Peak	10	Pass
NVNT	ax40	5795	Ant2	5875	-41.76	6.56	-35.2	Average	10	Pass
NVNT	ax40	5795	Ant2	5925	-45.05	6.56	-38.49	Peak	-27	Pass
NVNT	ax40	5795	Ant2	5925	-51.72	6.56	-45.16	Average	-27	Pass
NVNT	ax80	5775	Ant2	5850	-20.4	6.56	-13.84	Peak	27	Pass
NVNT	ax80	5775	Ant2	5850	-27.28	6.56	-20.72	Average	27	Pass
NVNT	ax80	5775	Ant2	5855	-21.79	6.56	-15.23	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5855	-28.34	6.56	-21.78	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5875	-26.16	6.56	-19.6	Peak	10	Pass
NVNT	ax80	5775	Ant2	5875	-34.39	6.56	-27.83	Average	10	Pass
NVNT	ax80	5775	Ant2	5925	-37.13	6.56	-30.57	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5925	-44.4	6.56	-37.84	Average	-27	Pass
NVNT	ax80	5775	Ant2	5650	-41.91	6.56	-35.35	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5650	-48.31	6.56	-41.75	Average	-27	Pass
NVNT	ax80	5775	Ant2	5700	-24.62	6.56	-18.06	Peak	10	Pass
NVNT	ax80	5775	Ant2	5700	-32.5	6.56	-25.94	Average	10	Pass
NVNT	ax80	5775	Ant2	5720	-23.2	6.56	-16.64	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5720	-28.79	6.56	-22.23	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5725	-20.74	6.56	-14.18	Peak	27	Pass
NVNT	ax80	5775	Ant2	5725	-28.26	6.56	-21.7	Average	27	Pass
NVNT	be20	5745	Ant2	5650	-48.3	6.56	-41.74	Peak	-27	Pass
NVNT	be20	5745	Ant2	5650	-56.66	6.56	-50.1	Average	-27	Pass
NVNT	be20	5745	Ant2	5700	-37.43	6.56	-30.87	Peak	10	Pass
NVNT	be20	5745	Ant2	5700	-47.61	6.56	-41.05	Average	10	Pass
NVNT	be20	5745	Ant2	5720	-22.9	6.56	-16.34	Peak	15.6	Pass
NVNT	be20	5745	Ant2	5720	-32.14	6.56	-25.58	Average	15.6	Pass
NVNT	be20	5745	Ant2	5725	-13.34	6.56	-6.78	Peak	27	Pass
NVNT	be20	5745	Ant2	5725	-24.75	6.56	-18.19	Average	27	Pass
NVNT	be20	5825	Ant2	5850	-20.81	6.56	-14.25	Peak	27	Pass
NVNT	be20	5825	Ant2	5850	-26.95	6.56	-20.39	Average	27	Pass
NVNT	be20	5825	Ant2	5855	-26	6.56	-19.44	Peak	15.6	Pass
NVNT	be20	5825	Ant2	5855	-34.12	6.56	-27.56	Average	15.6	Pass
NVNT	be20	5825	Ant2	5875	-34.66	6.56	-28.1	Peak	10	Pass
NVNT	be20	5825	Ant2	5875	-43.95	6.56	-37.39	Average	10	Pass
NVNT	be20	5825	Ant2	5925	-48.27	6.56	-41.71	Peak	-27	Pass
NVNT	be20	5825	Ant2	5925	-55.37	6.56	-48.81	Average	-27	Pass
NVNT	be40	5755	Ant2	5650	-41.95	6.56	-35.39	Peak	-27	Pass
NVNT	be40	5755	Ant2	5650	-51.45	6.56	-44.89	Average	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5755	Ant2	5700	-32.35	6.56	-25.79	Peak	10	Pass
NVNT	be40	5755	Ant2	5700	-40.34	6.56	-33.78	Average	10	Pass
NVNT	be40	5755	Ant2	5720	-18.5	6.56	-11.94	Peak	15.6	Pass
NVNT	be40	5755	Ant2	5720	-26.18	6.56	-19.62	Average	15.6	Pass
NVNT	be40	5755	Ant2	5725	-17.2	6.56	-10.64	Peak	27	Pass
NVNT	be40	5755	Ant2	5725	-24.12	6.56	-17.56	Average	27	Pass
NVNT	be40	5795	Ant2	5850	-24.9	6.56	-18.34	Peak	27	Pass
NVNT	be40	5795	Ant2	5850	-32.93	6.56	-26.37	Average	27	Pass
NVNT	be40	5795	Ant2	5855	-27.57	6.56	-21.01	Peak	15.6	Pass
NVNT	be40	5795	Ant2	5855	-36.33	6.56	-29.77	Average	15.6	Pass
NVNT	be40	5795	Ant2	5875	-34.53	6.56	-27.97	Peak	10	Pass
NVNT	be40	5795	Ant2	5875	-41.65	6.56	-35.09	Average	10	Pass
NVNT	be40	5795	Ant2	5925	-41.35	6.56	-34.79	Peak	-27	Pass
NVNT	be40	5795	Ant2	5925	-51.71	6.56	-45.15	Average	-27	Pass
NVNT	be80	5775	Ant2	5850	-21.28	6.56	-14.72	Peak	27	Pass
NVNT	be80	5775	Ant2	5850	-26.35	6.56	-19.79	Average	27	Pass
NVNT	be80	5775	Ant2	5855	-23.21	6.56	-16.65	Peak	15.6	Pass
NVNT	be80	5775	Ant2	5855	-28.77	6.56	-22.21	Average	15.6	Pass
NVNT	be80	5775	Ant2	5875	-24.26	6.56	-17.7	Peak	10	Pass
NVNT	be80	5775	Ant2	5875	-34.29	6.56	-27.73	Average	10	Pass
NVNT	be80	5775	Ant2	5925	-35.92	6.56	-29.36	Peak	-27	Pass
NVNT	be80	5775	Ant2	5925	-43.14	6.56	-36.58	Average	-27	Pass
NVNT	be80	5775	Ant2	5650	-38.75	6.56	-32.19	Peak	-27	Pass
NVNT	be80	5775	Ant2	5650	-48.25	6.56	-41.69	Average	-27	Pass
NVNT	be80	5775	Ant2	5700	-24.92	6.56	-18.36	Peak	10	Pass
NVNT	be80	5775	Ant2	5700	-32.44	6.56	-25.88	Average	10	Pass
NVNT	be80	5775	Ant2	5720	-22.09	6.56	-15.53	Peak	15.6	Pass
NVNT	be80	5775	Ant2	5720	-28.92	6.56	-22.36	Average	15.6	Pass
NVNT	be80	5775	Ant2	5725	-21.63	6.56	-15.07	Peak	27	Pass
NVNT	be80	5775	Ant2	5725	-28.61	6.56	-22.05	Average	27	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

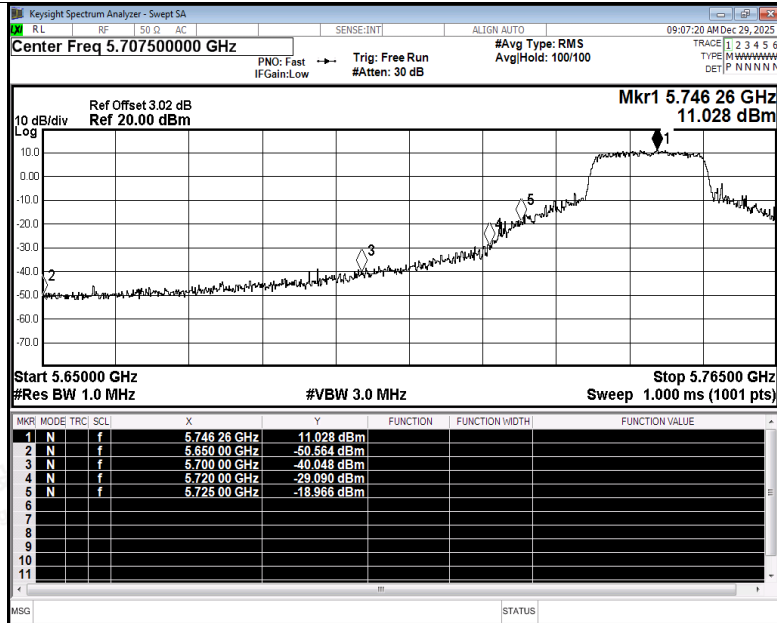

Restrict Band NVNT a 5745MHz Ant2 Peak

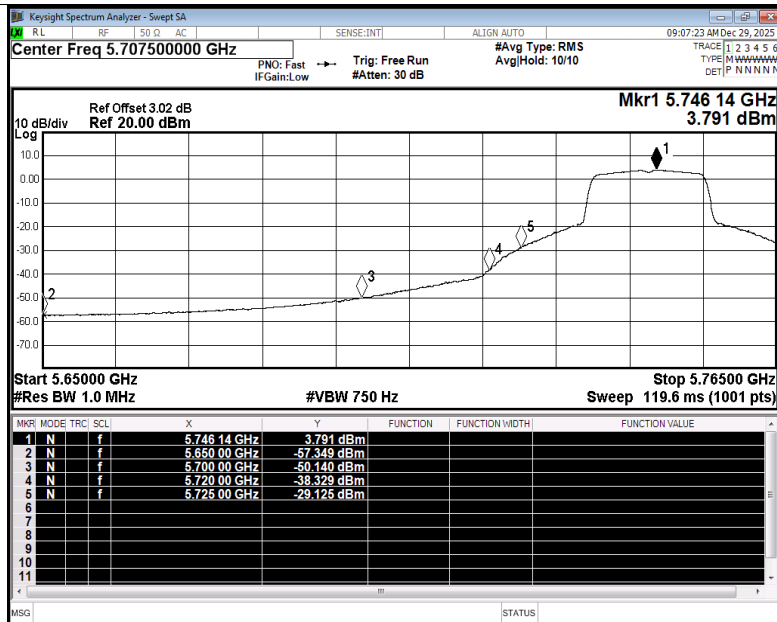

Restrict Band NVNT a 5745MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

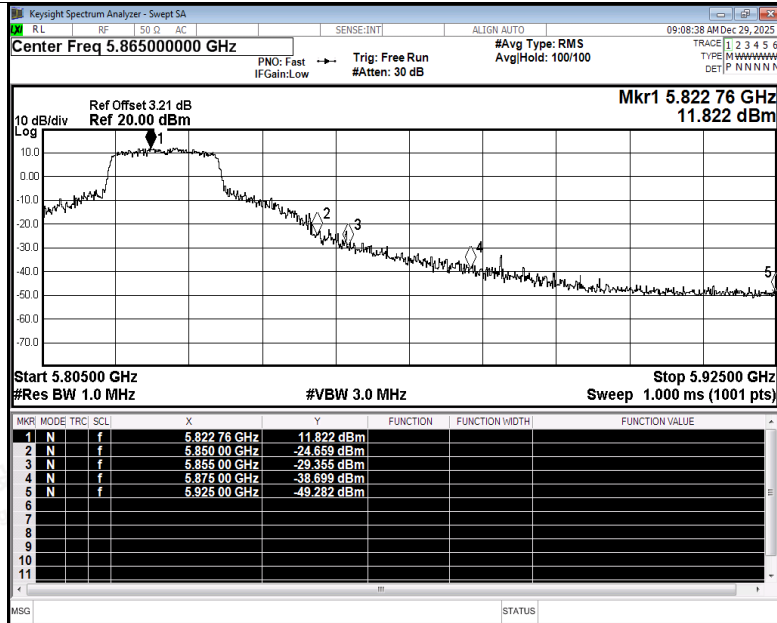

Restrict Band NVNT a 5825MHz Ant2 Peak

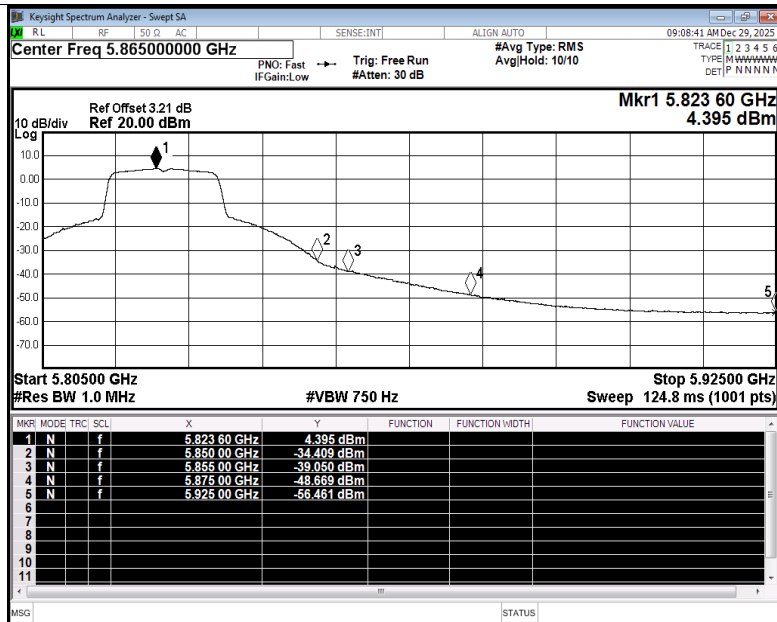

Restrict Band NVNT a 5825MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

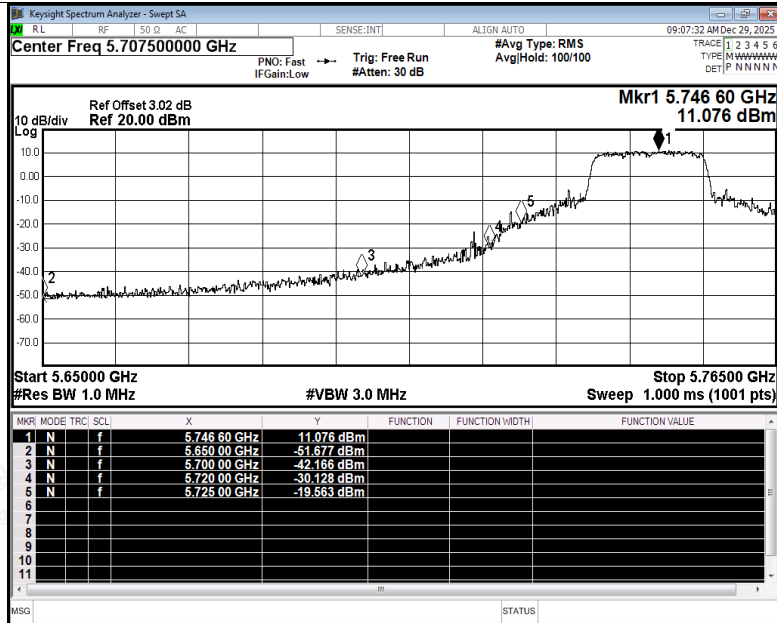

Restrict Band NVNT n20 5745MHz Ant2 Peak

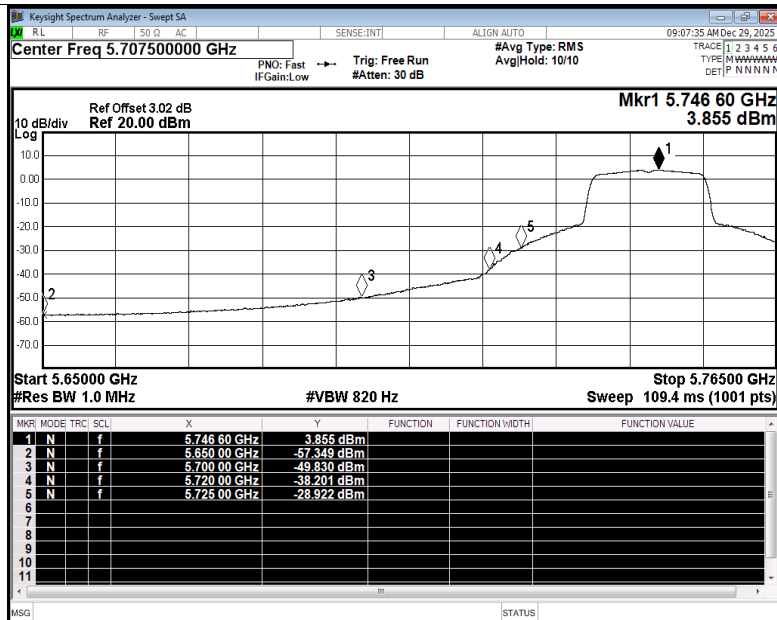

Restrict Band NVNT n20 5745MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

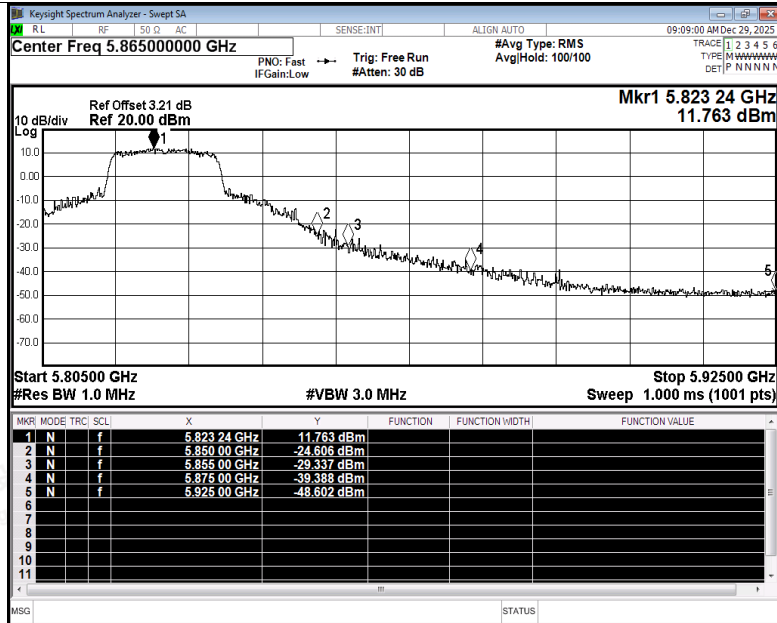

Restrict Band NVNT n20 5825MHz Ant2 Peak

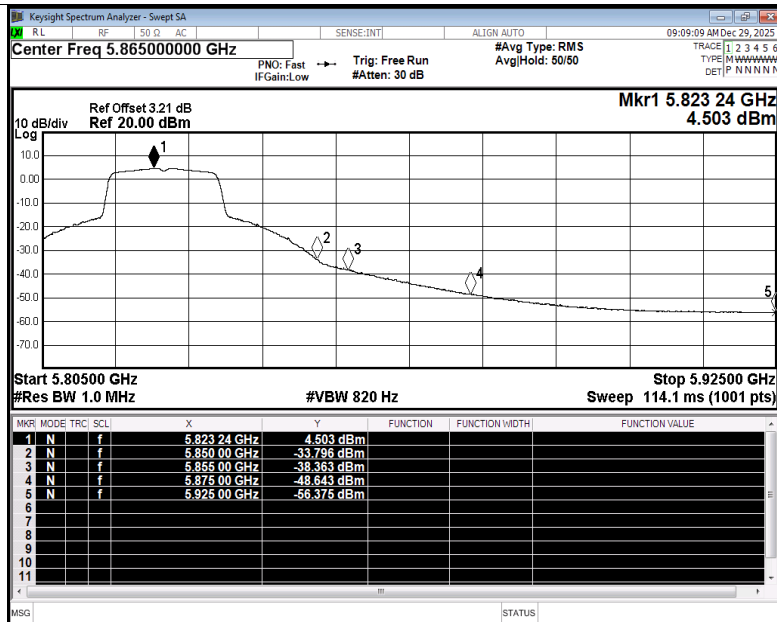

Restrict Band NVNT n20 5825MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

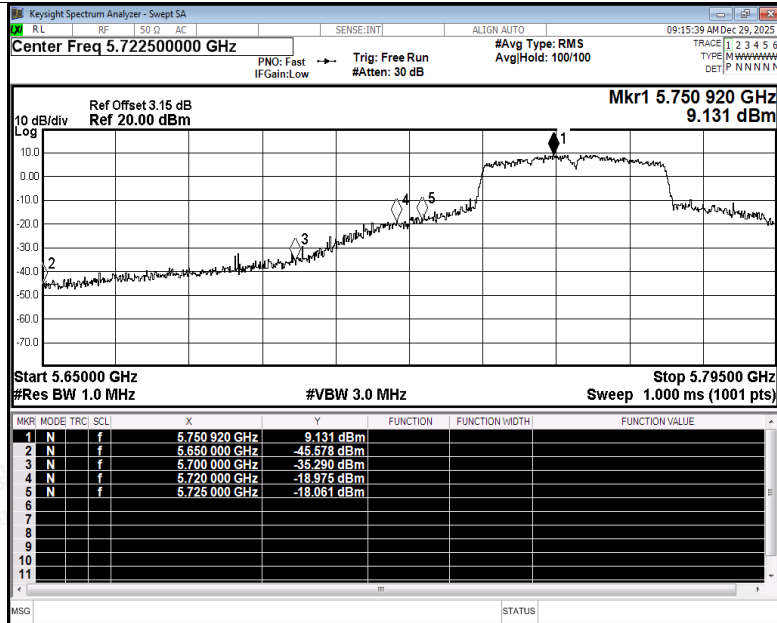

Restrict Band NVNT n40 5755MHz Ant2 Peak

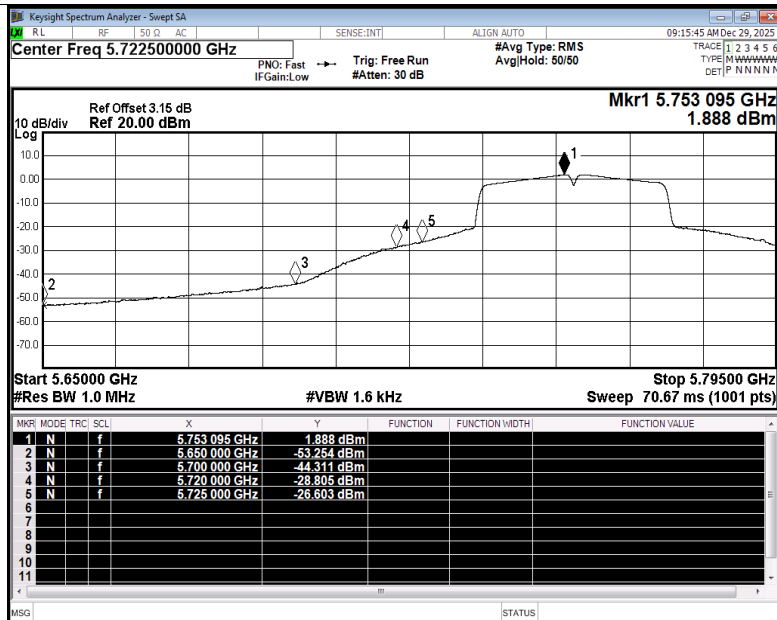

Restrict Band NVNT n40 5755MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

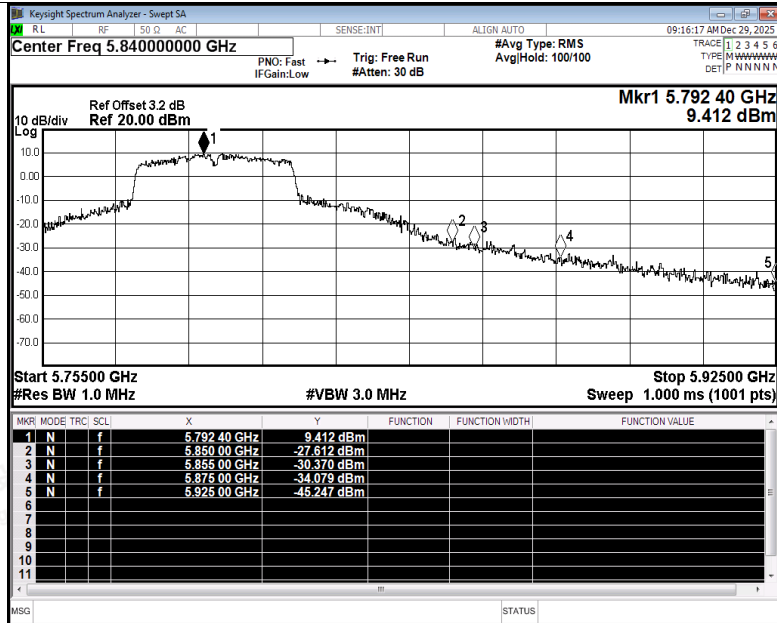

Restrict Band NVNT n40 5795MHz Ant2 Peak

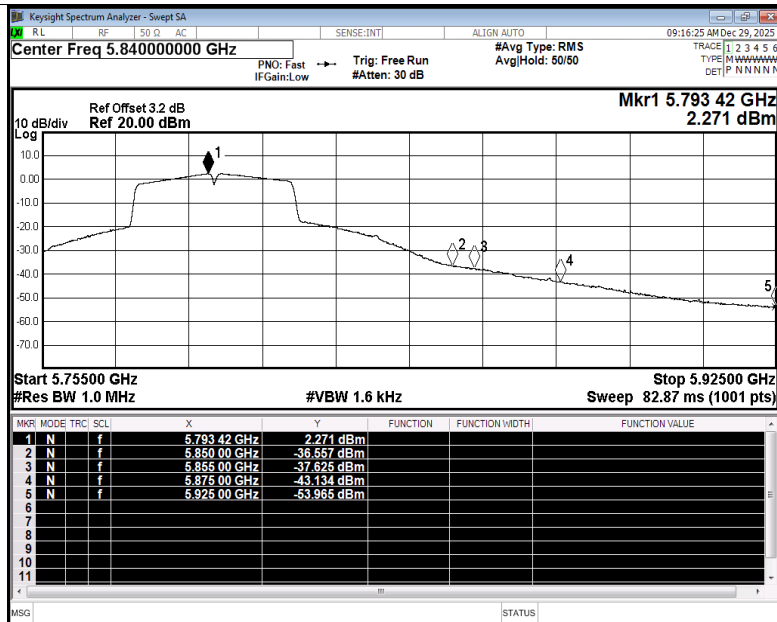

Restrict Band NVNT n40 5795MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

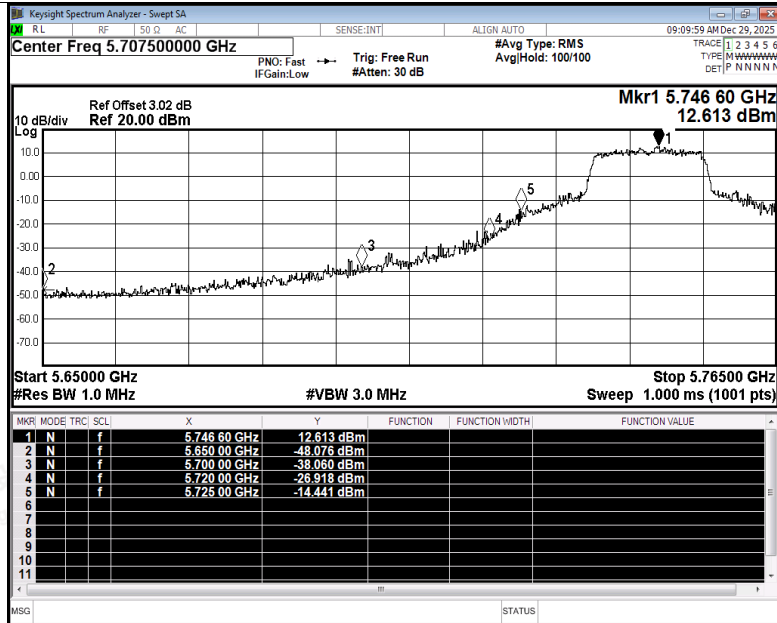

Restrict Band NVNT ac20 5745MHz Ant2 Peak

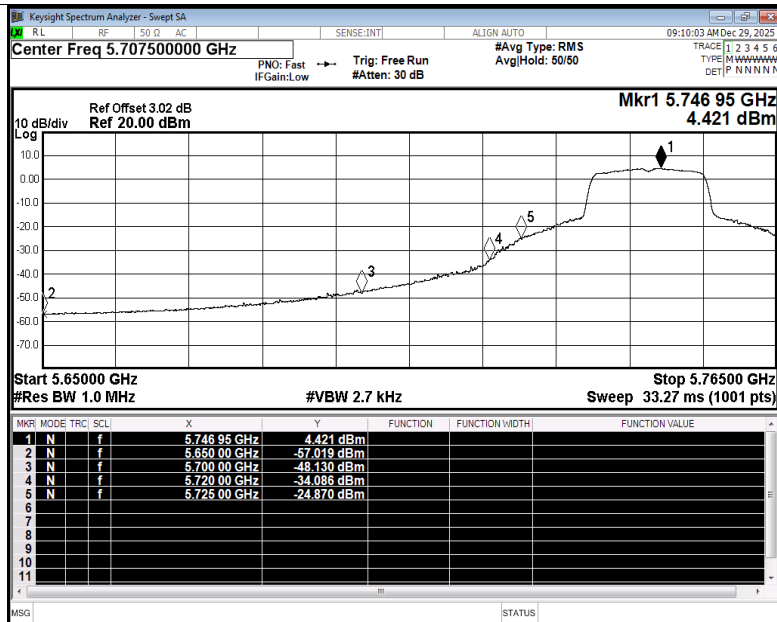

Restrict Band NVNT ac20 5745MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

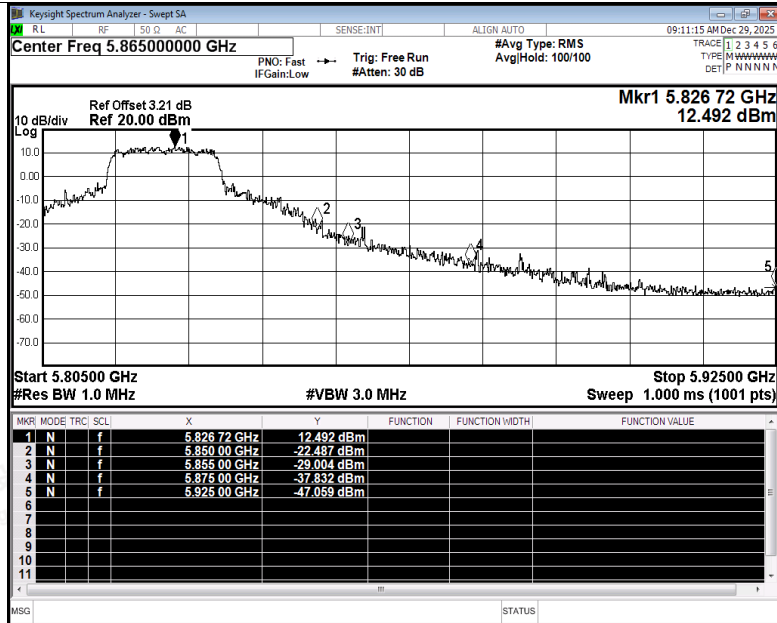

Restrict Band NVNT ac20 5825MHz Ant2 Peak

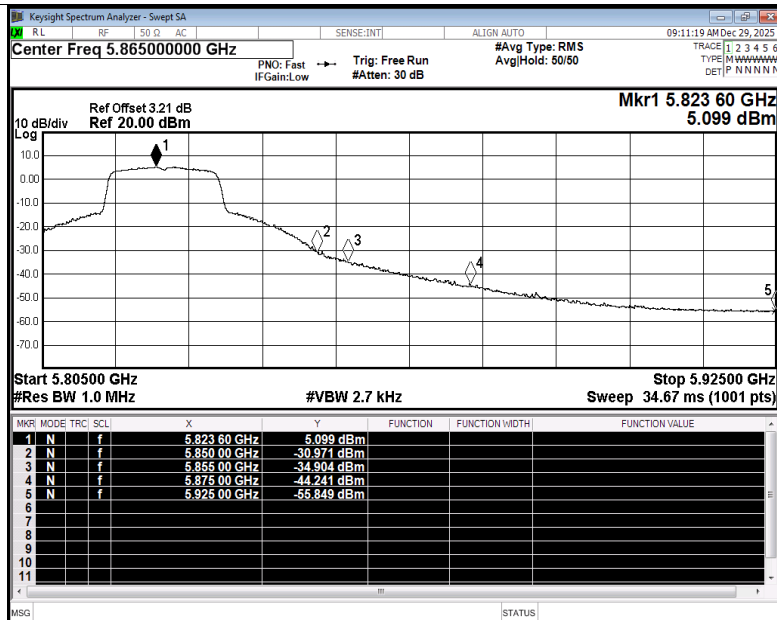

Restrict Band NVNT ac20 5825MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

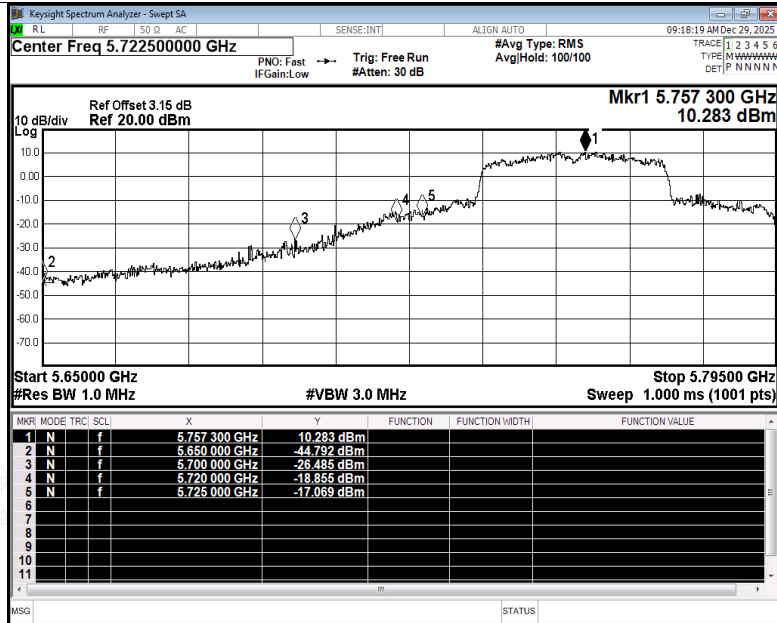

Restrict Band NVNT ac40 5755MHz Ant2 Peak

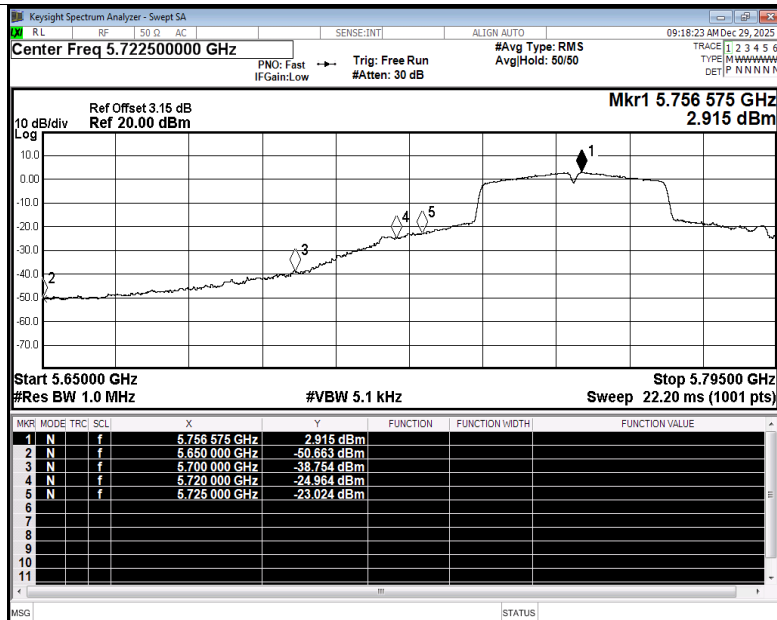

Restrict Band NVNT ac40 5755MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

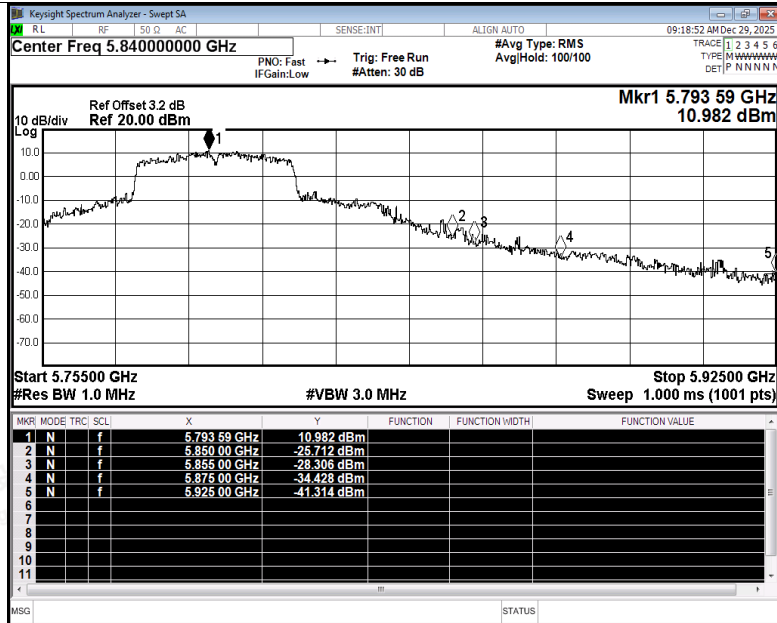

Restrict Band NVNT ac40 5795MHz Ant2 Peak

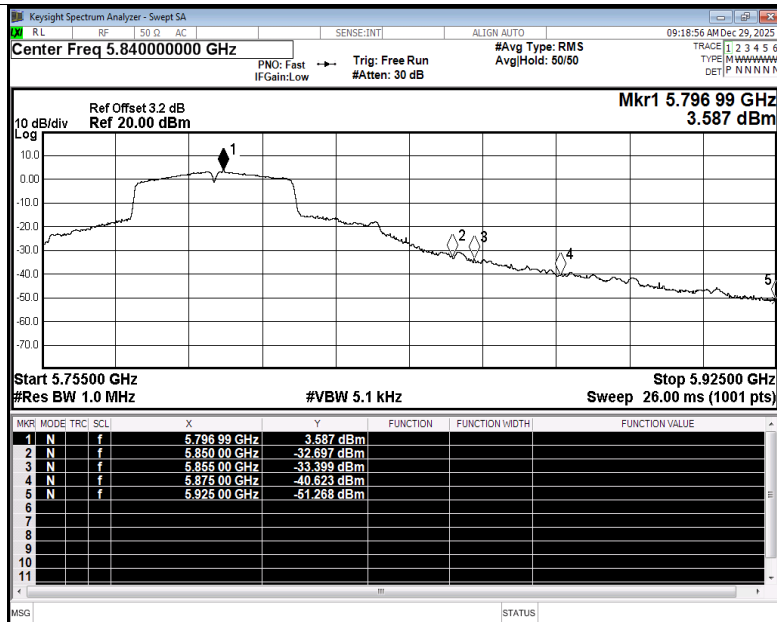

Restrict Band NVNT ac40 5795MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

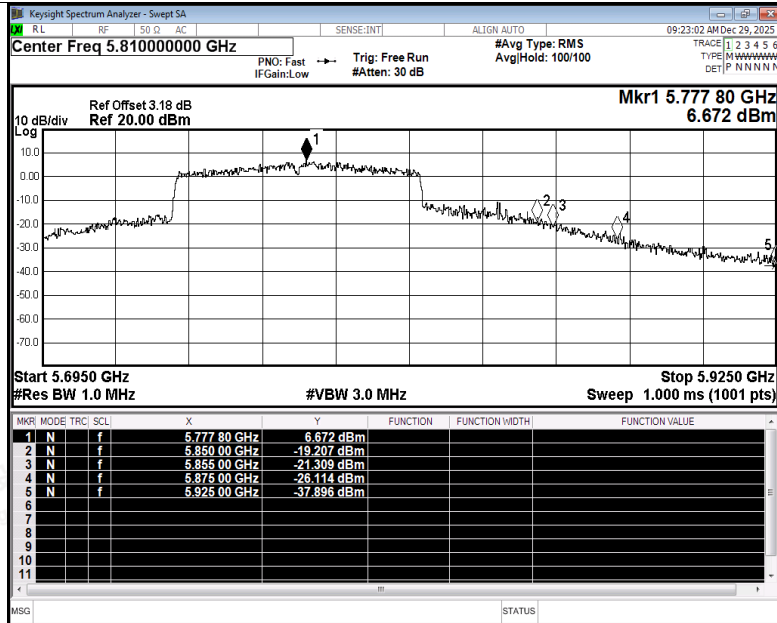

Restrict Band NVNT ac80 5775MHz Ant2 Peak

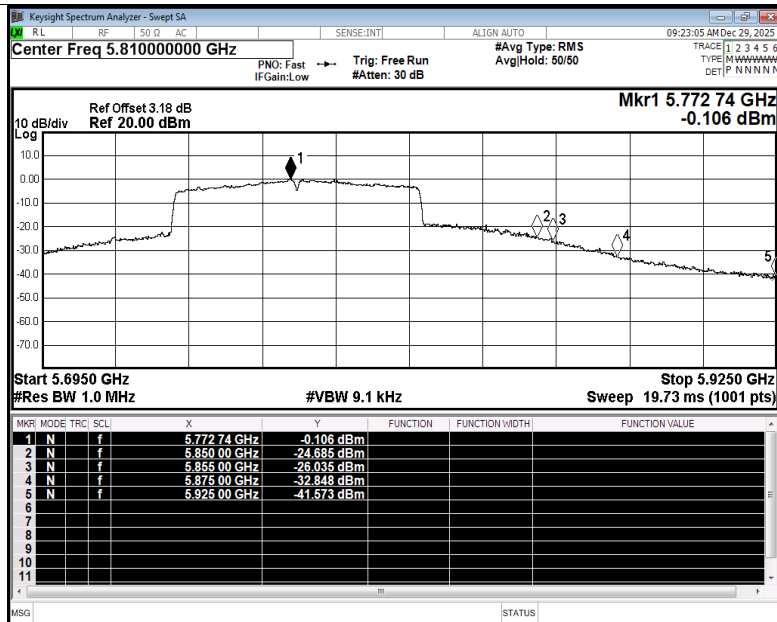

Restrict Band NVNT ac80 5775MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

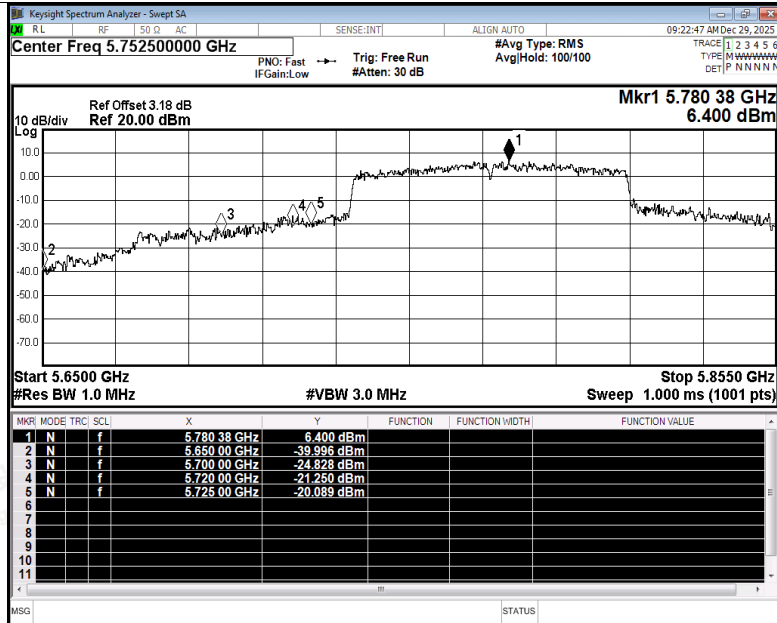

Restrict Band NVNT ac80 5775MHz Ant2 Peak

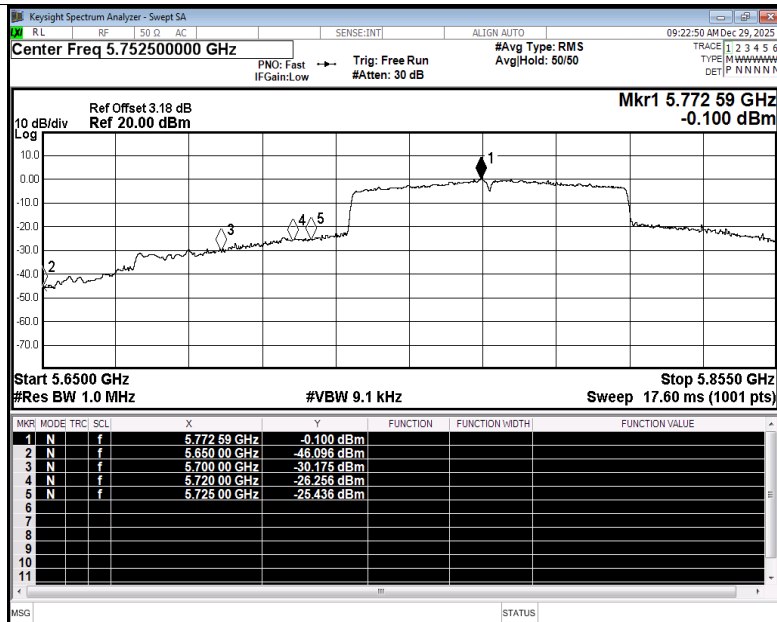

Restrict Band NVNT ac80 5775MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

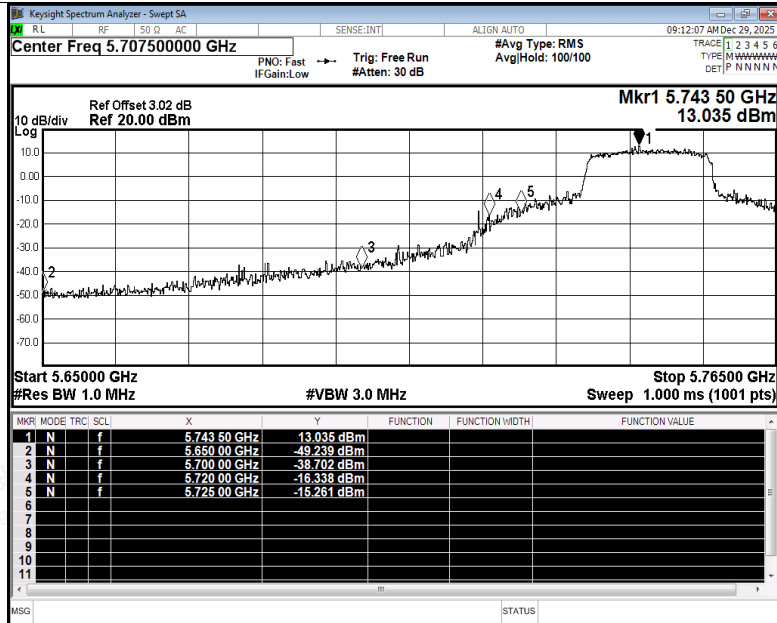

Restrict Band NVNT ax20 5745MHz Ant2 Peak

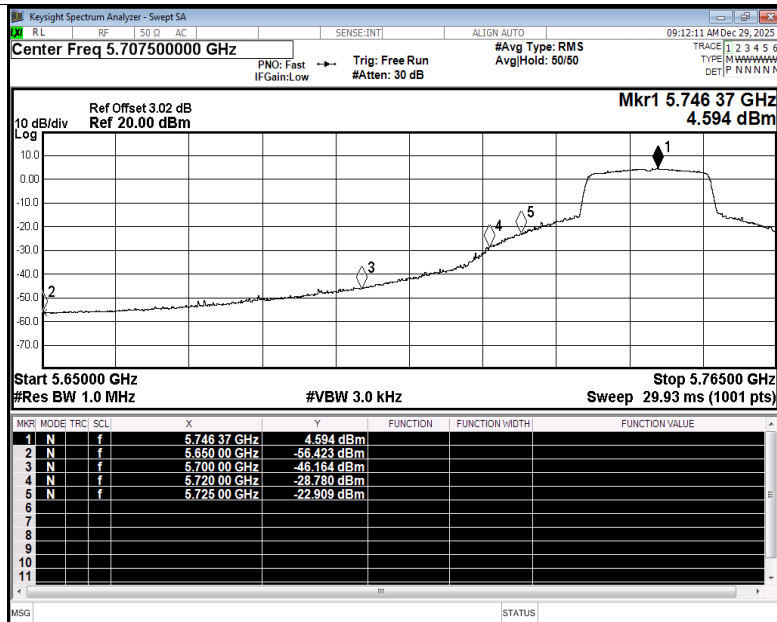

Restrict Band NVNT ax20 5745MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

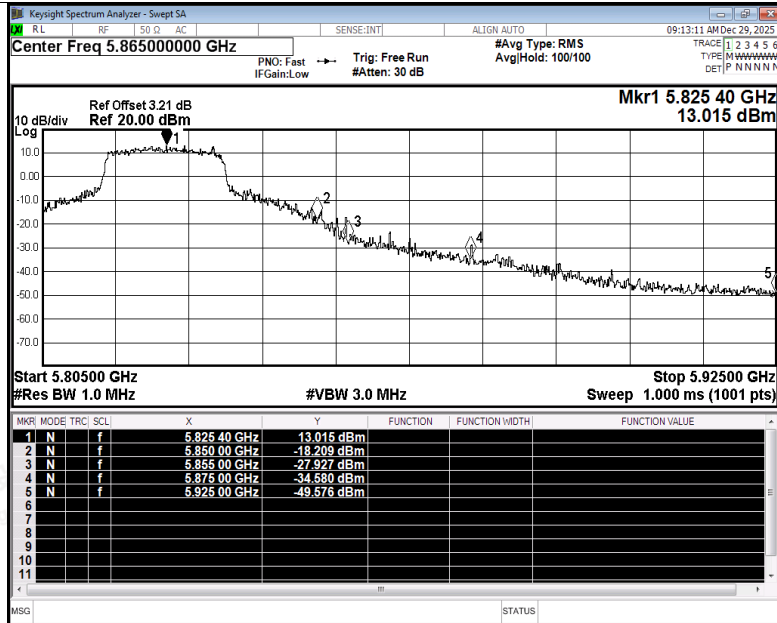

Restrict Band NVNT ax20 5825MHz Ant2 Peak

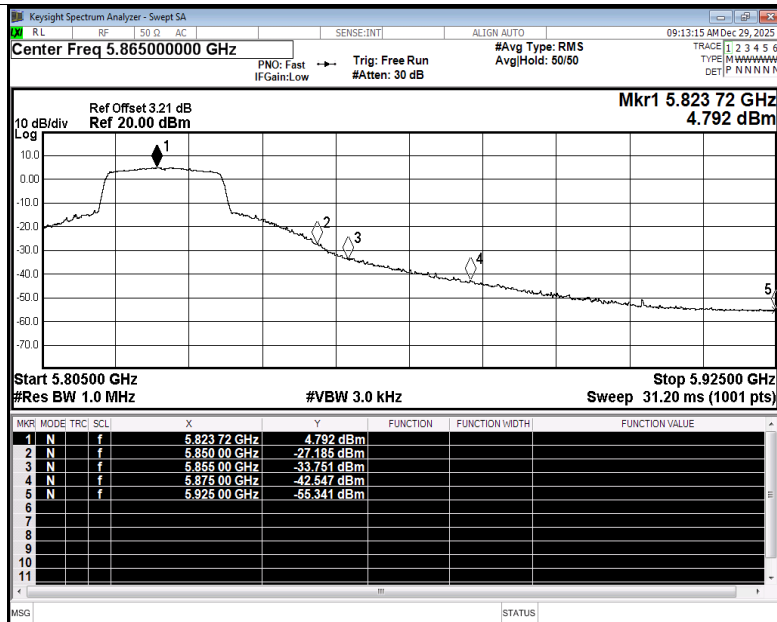

Restrict Band NVNT ax20 5825MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

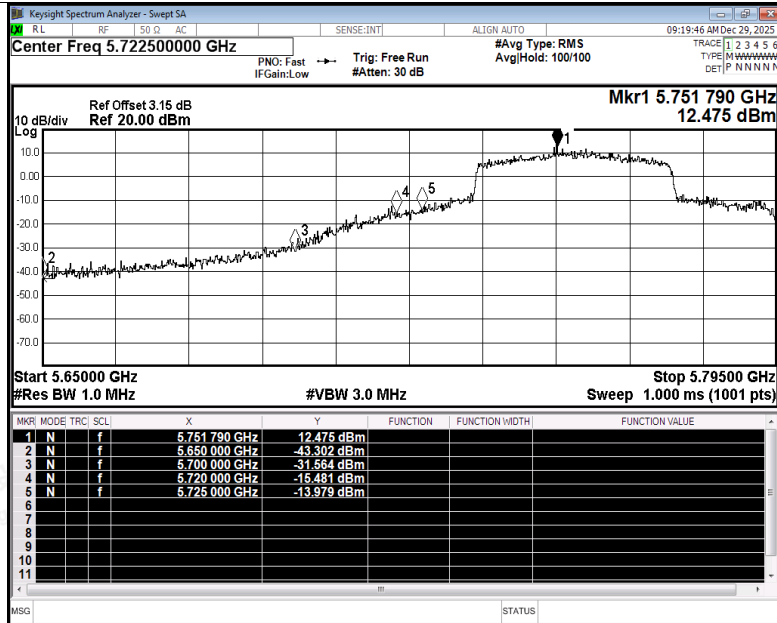

Restrict Band NVNT ax40 5755MHz Ant2 Peak

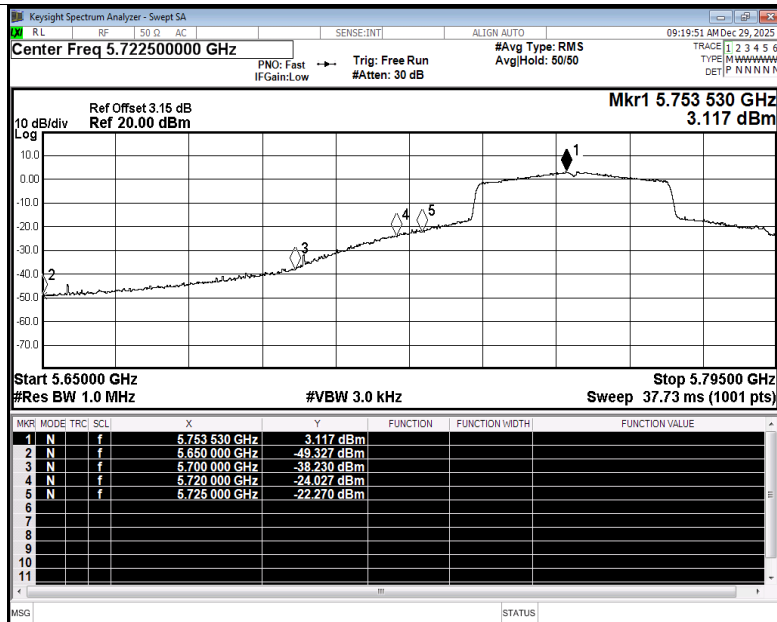

Restrict Band NVNT ax40 5755MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

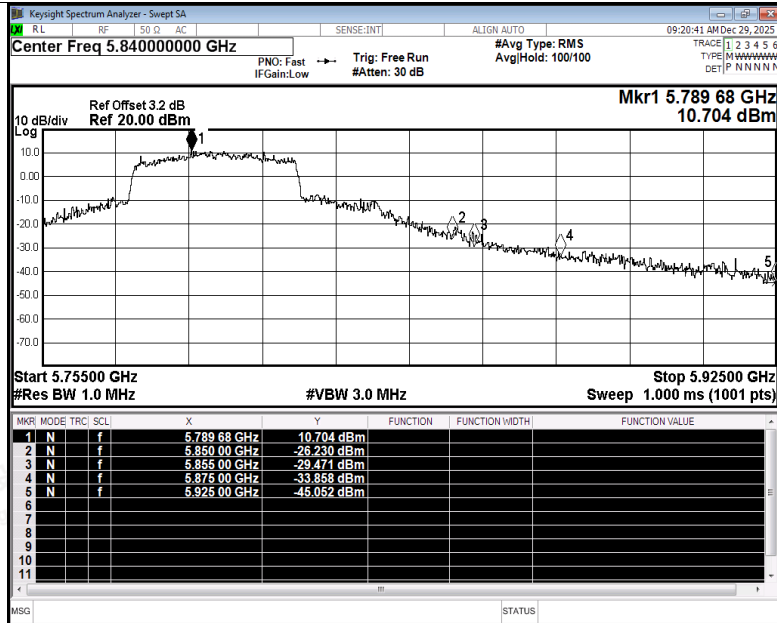

Restrict Band NVNT ax40 5795MHz Ant2 Peak

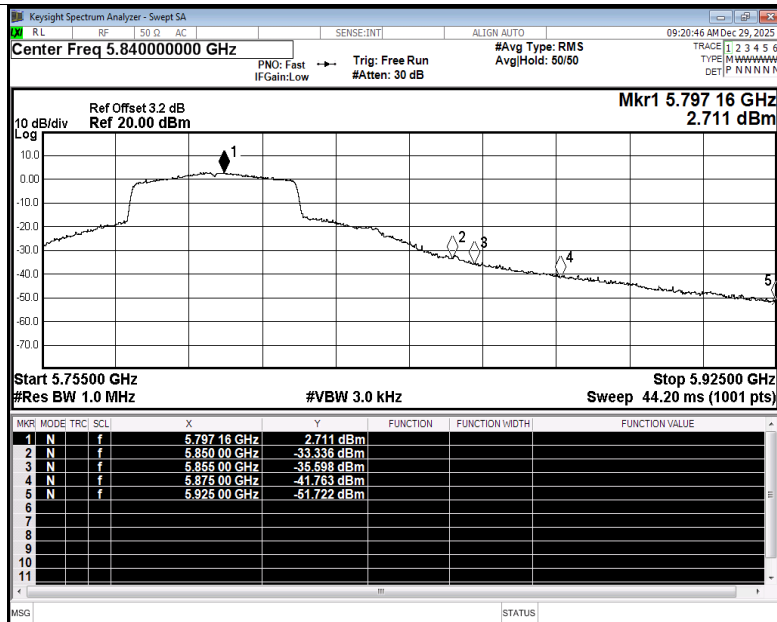

Restrict Band NVNT ax40 5795MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

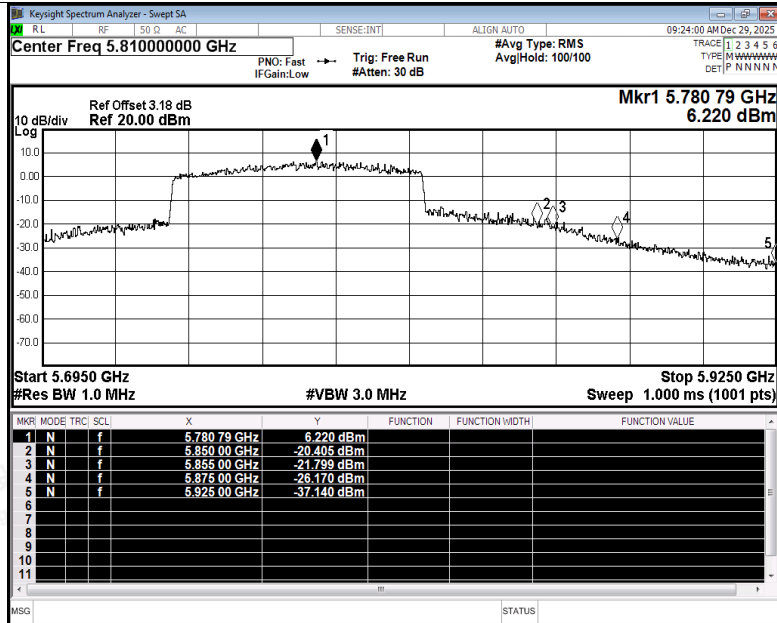

Restrict Band NVNT ax80 5775MHz Ant2 Peak

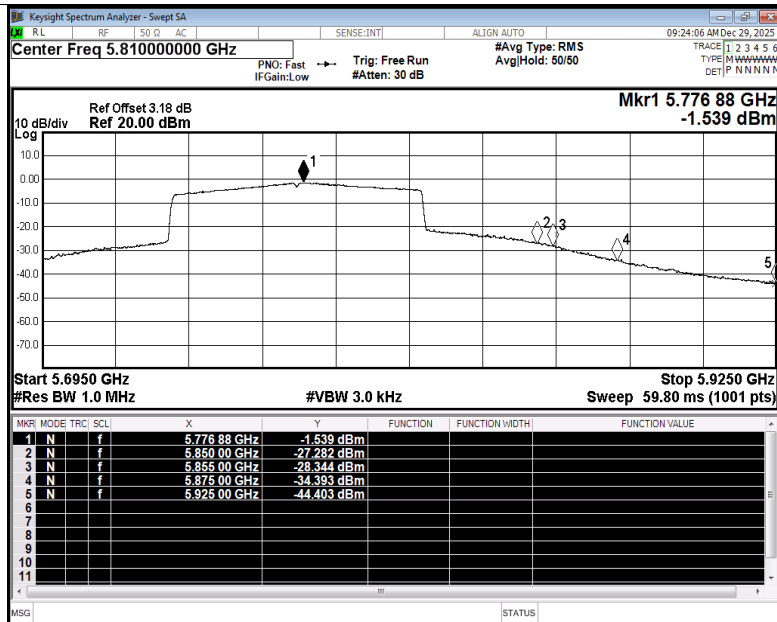

Restrict Band NVNT ax80 5775MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

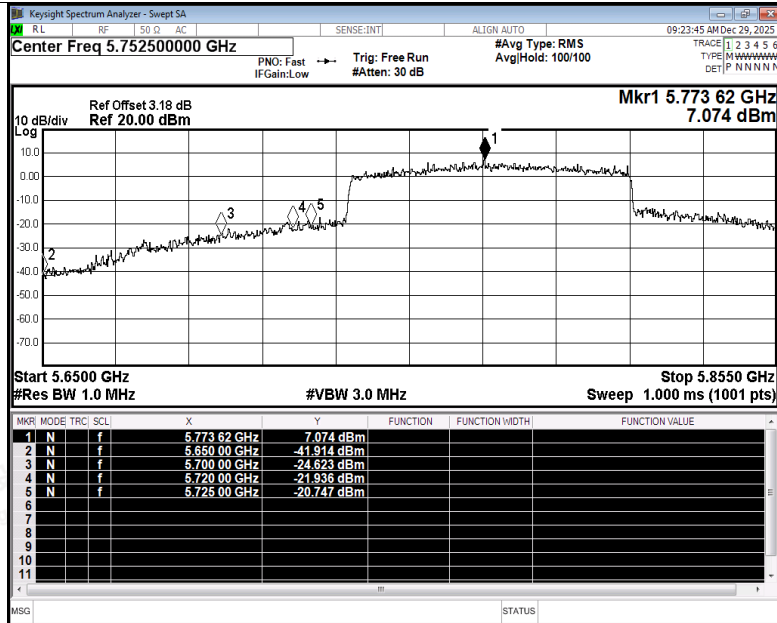

Restrict Band NVNT ax80 5775MHz Ant2 Peak

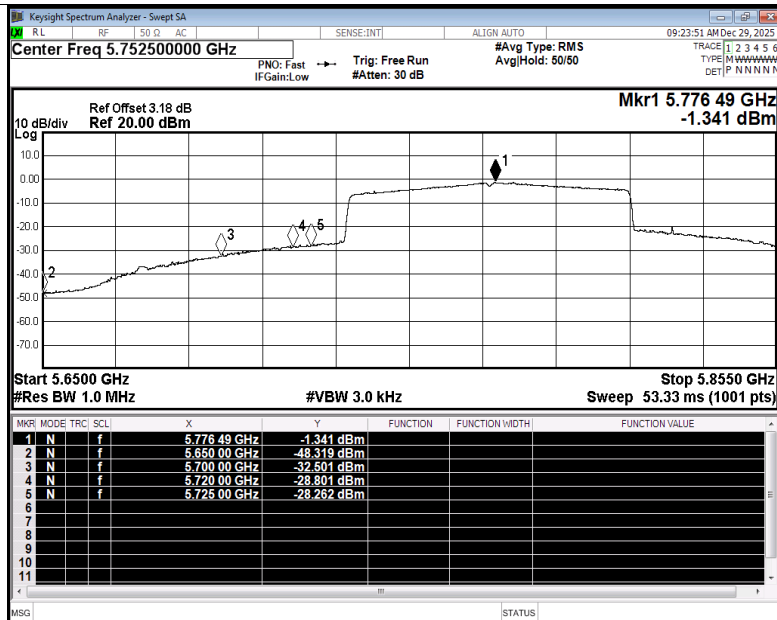

Restrict Band NVNT ax80 5775MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

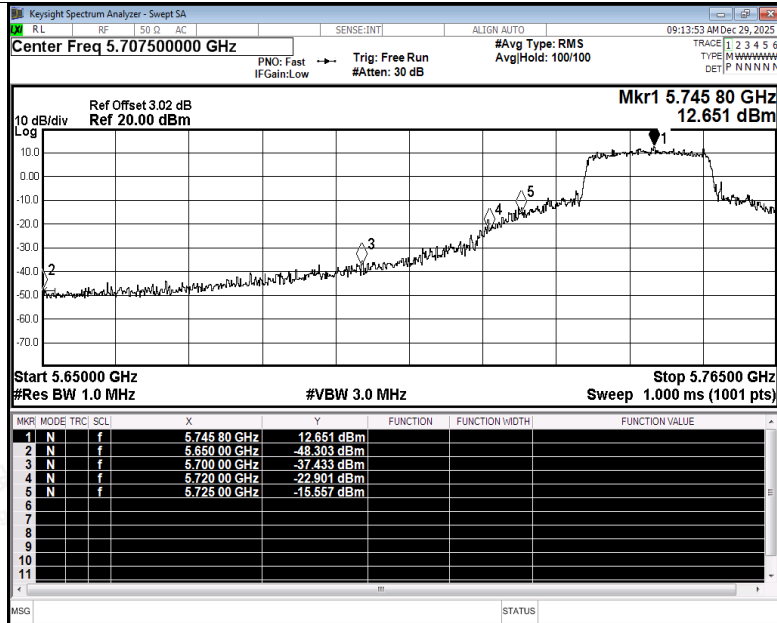

Restrict Band NVNT be20 5745MHz Ant2 Peak

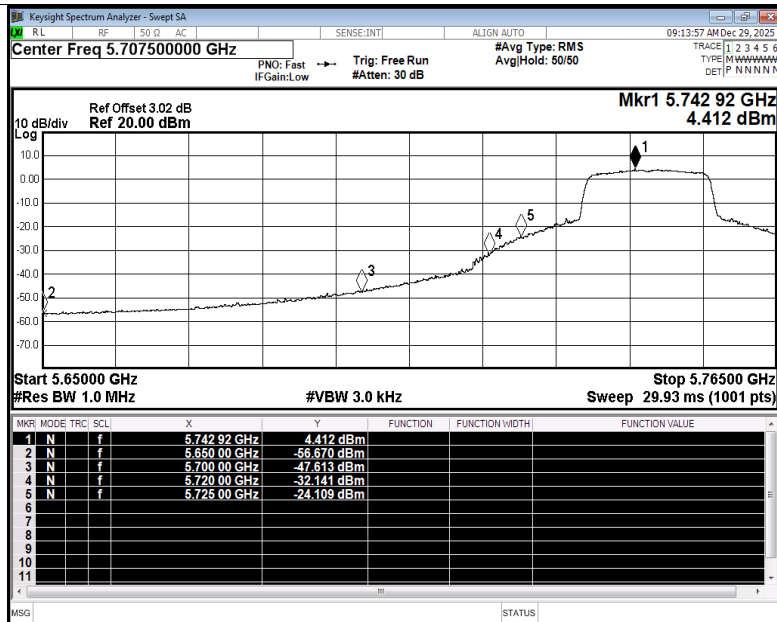

Restrict Band NVNT be20 5745MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

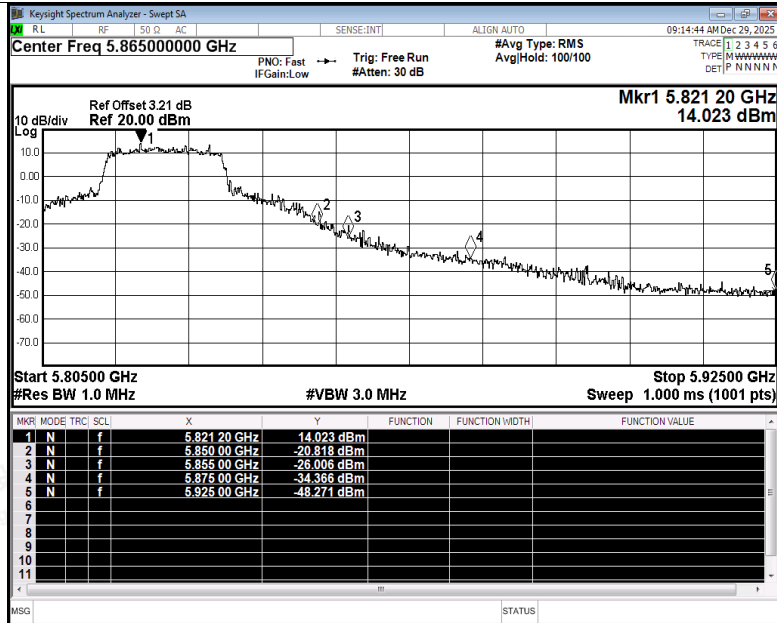

Restrict Band NVNT be20 5825MHz Ant2 Peak

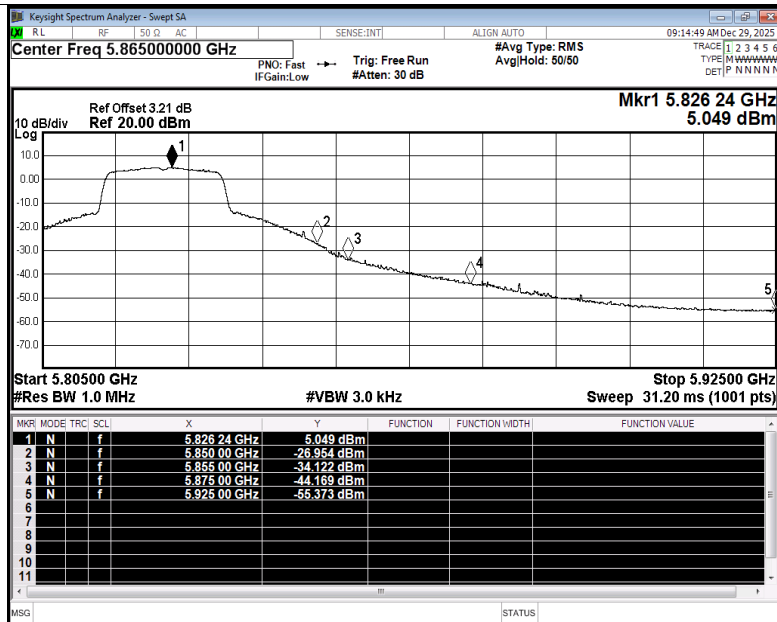

Restrict Band NVNT be20 5825MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

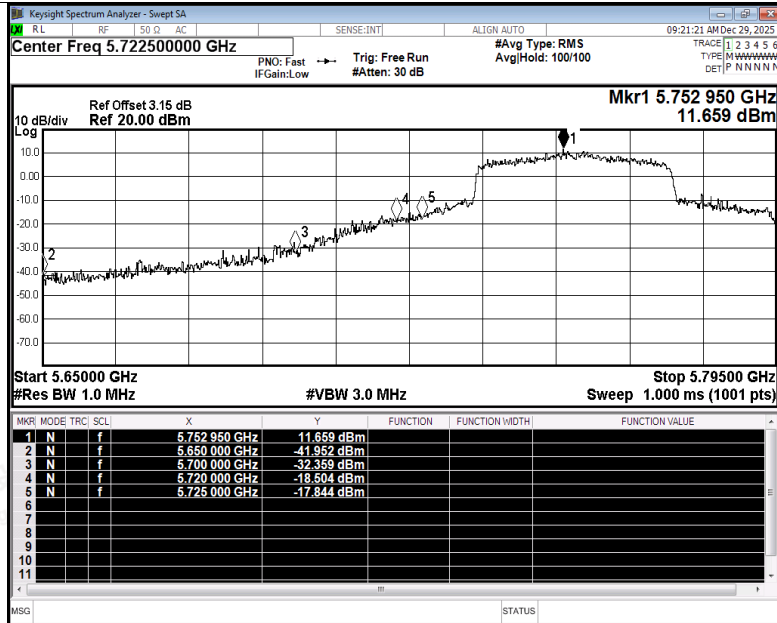

Restrict Band NVNT be40 5755MHz Ant2 Peak

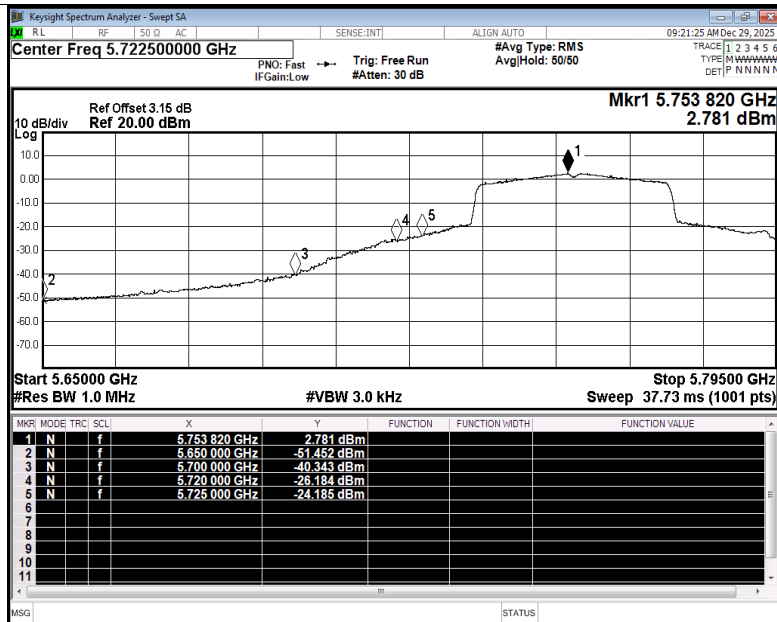

Restrict Band NVNT be40 5755MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

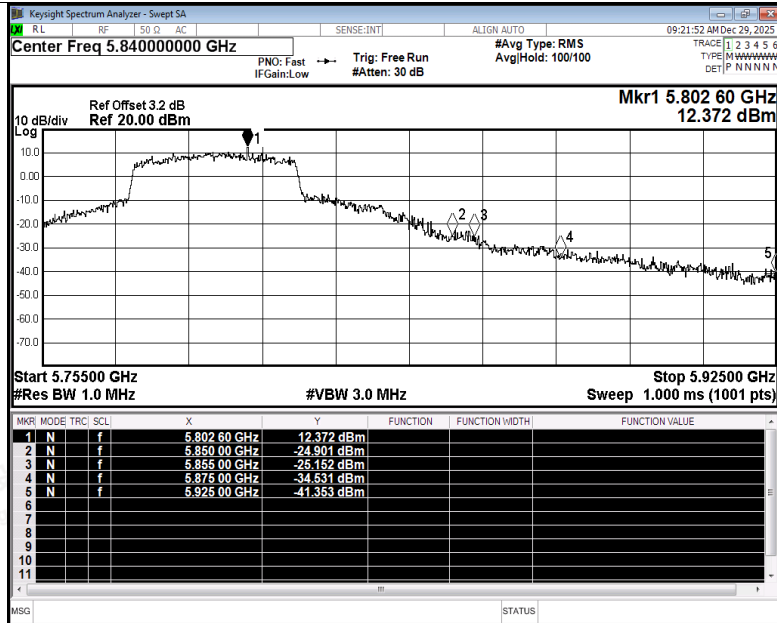

Restrict Band NVNT be40 5795MHz Ant2 Peak

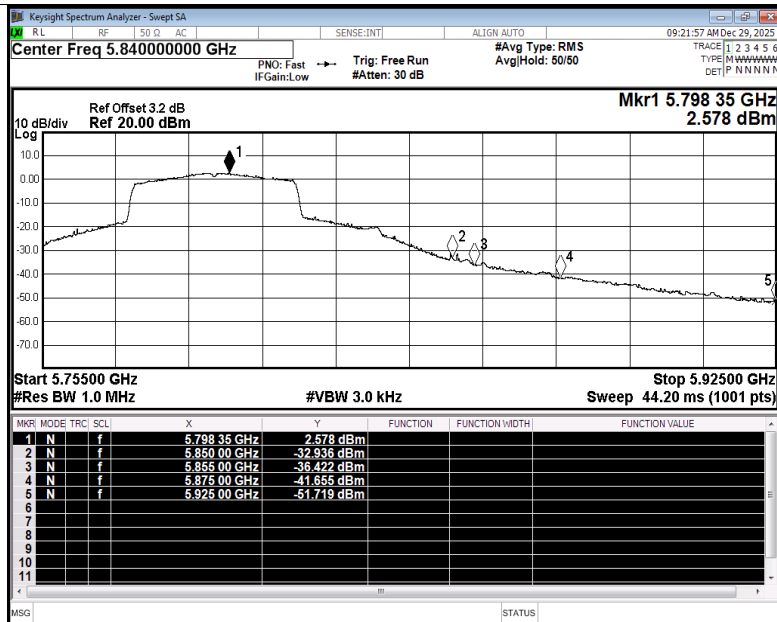

Restrict Band NVNT be40 5795MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

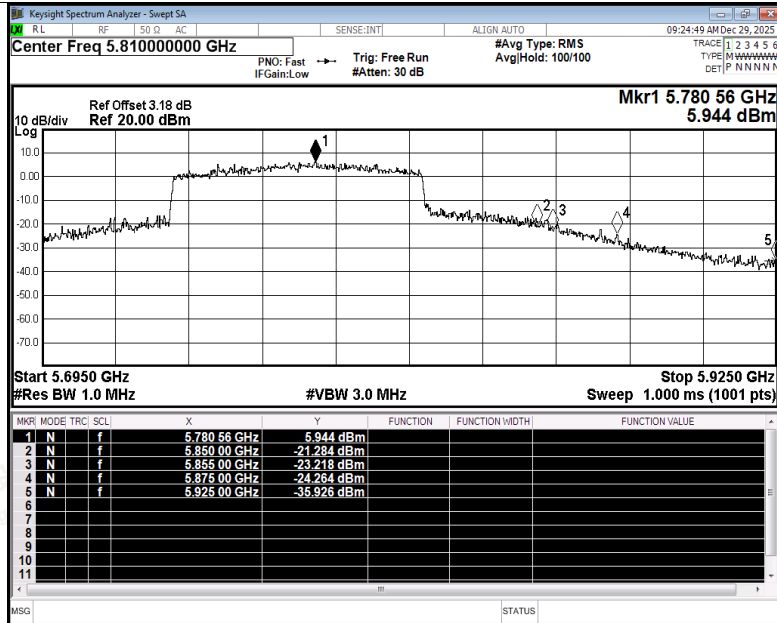

Restrict Band NVNT be80 5775MHz Ant2 Peak

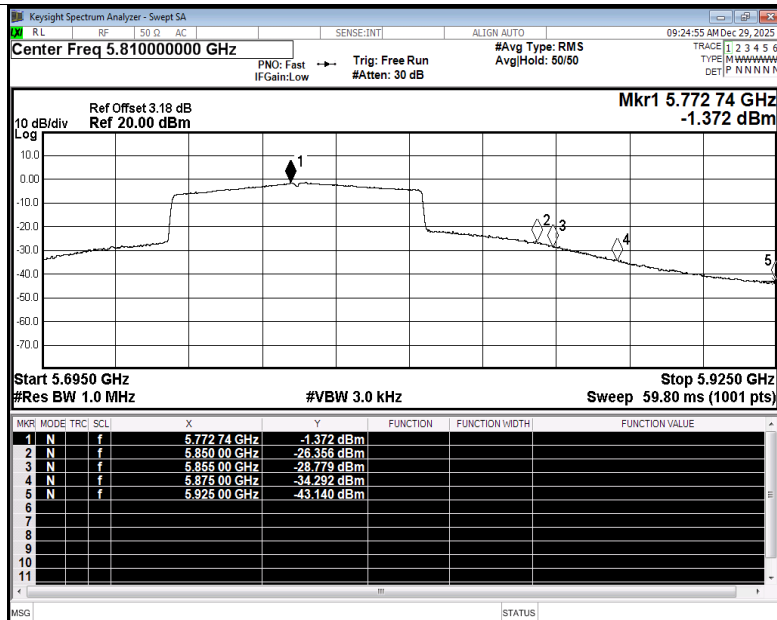

Restrict Band NVNT be80 5775MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

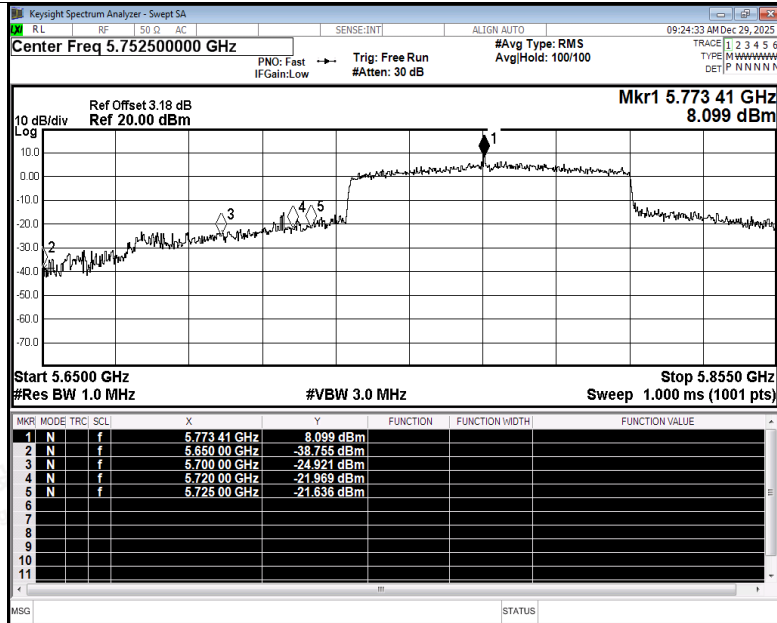

Restrict Band NVNT be80 5775MHz Ant2 Peak

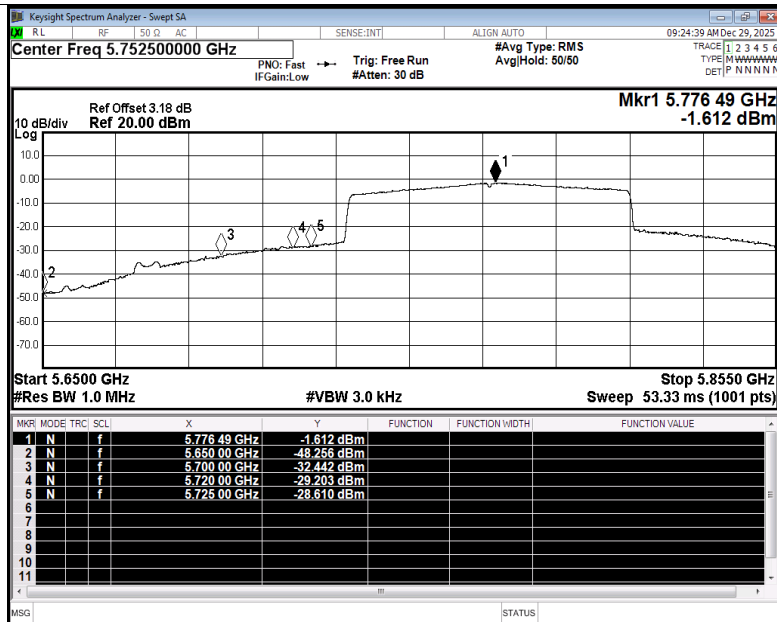

Restrict Band NVNT be80 5775MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	EIRP (dBm)	Detector	Limit (dB/m)	Verdict
NVNT	a	5745	Ant3	5650	-48.88	6.56	-42.32	Peak	-27	Pass
NVNT	a	5745	Ant3	5650	-57	6.56	-50.44	Average	-27	Pass
NVNT	a	5745	Ant3	5700	-34.33	6.56	-27.77	Peak	10	Pass
NVNT	a	5745	Ant3	5700	-45.58	6.56	-39.02	Average	10	Pass
NVNT	a	5745	Ant3	5720	-26.16	6.56	-19.6	Peak	15.6	Pass
NVNT	a	5745	Ant3	5720	-34.38	6.56	-27.82	Average	15.6	Pass
NVNT	a	5745	Ant3	5725	-17.46	6.56	-10.9	Peak	27	Pass
NVNT	a	5745	Ant3	5725	-26.52	6.56	-19.96	Average	27	Pass
NVNT	a	5825	Ant3	5850	-30.28	6.56	-23.72	Peak	27	Pass
NVNT	a	5825	Ant3	5850	-38.42	6.56	-31.86	Average	27	Pass
NVNT	a	5825	Ant3	5855	-31.9	6.56	-25.34	Peak	15.6	Pass
NVNT	a	5825	Ant3	5855	-41.13	6.56	-34.57	Average	15.6	Pass
NVNT	a	5825	Ant3	5875	-41.8	6.56	-35.24	Peak	10	Pass
NVNT	a	5825	Ant3	5875	-52.66	6.56	-46.1	Average	10	Pass
NVNT	a	5825	Ant3	5925	-50.44	6.56	-43.88	Peak	-27	Pass
NVNT	a	5825	Ant3	5925	-56.65	6.56	-50.09	Average	-27	Pass
NVNT	n20	5745	Ant3	5650	-49.77	6.56	-43.21	Peak	-27	Pass
NVNT	n20	5745	Ant3	5650	-57.19	6.56	-50.63	Average	-27	Pass
NVNT	n20	5745	Ant3	5700	-37.41	6.56	-30.85	Peak	10	Pass
NVNT	n20	5745	Ant3	5700	-46.08	6.56	-39.52	Average	10	Pass
NVNT	n20	5745	Ant3	5720	-25.45	6.56	-18.89	Peak	15.6	Pass
NVNT	n20	5745	Ant3	5720	-34.58	6.56	-28.02	Average	15.6	Pass
NVNT	n20	5745	Ant3	5725	-16.72	6.56	-10.16	Peak	27	Pass
NVNT	n20	5745	Ant3	5725	-26.72	6.56	-20.16	Average	27	Pass
NVNT	n20	5825	Ant3	5850	-27.1	6.56	-20.54	Peak	27	Pass
NVNT	n20	5825	Ant3	5850	-36.8	6.56	-30.24	Average	27	Pass
NVNT	n20	5825	Ant3	5855	-31.12	6.56	-24.56	Peak	15.6	Pass
NVNT	n20	5825	Ant3	5855	-41.09	6.56	-34.53	Average	15.6	Pass
NVNT	n20	5825	Ant3	5875	-40.53	6.56	-33.97	Peak	10	Pass
NVNT	n20	5825	Ant3	5875	-52.18	6.56	-45.62	Average	10	Pass
NVNT	n20	5825	Ant3	5925	-47.01	6.56	-40.45	Peak	-27	Pass
NVNT	n20	5825	Ant3	5925	-56.53	6.56	-49.97	Average	-27	Pass
NVNT	n40	5755	Ant3	5650	-38.94	6.56	-32.38	Peak	-27	Pass
NVNT	n40	5755	Ant3	5650	-48.23	6.56	-41.67	Average	-27	Pass
NVNT	n40	5755	Ant3	5700	-28.66	6.56	-22.1	Peak	10	Pass
NVNT	n40	5755	Ant3	5700	-37.43	6.56	-30.87	Average	10	Pass
NVNT	n40	5755	Ant3	5720	-15.11	6.56	-8.55	Peak	15.6	Pass
NVNT	n40	5755	Ant3	5720	-25.37	6.56	-18.81	Average	15.6	Pass
NVNT	n40	5755	Ant3	5725	-15.25	6.56	-8.69	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant3	5725	-23.34	6.56	-16.78	Average	27	Pass
NVNT	n40	5795	Ant3	5850	-27.1	6.56	-20.54	Peak	27	Pass
NVNT	n40	5795	Ant3	5850	-35.88	6.56	-29.32	Average	27	Pass
NVNT	n40	5795	Ant3	5855	-29.13	6.56	-22.57	Peak	15.6	Pass
NVNT	n40	5795	Ant3	5855	-38.03	6.56	-31.47	Average	15.6	Pass
NVNT	n40	5795	Ant3	5875	-35.34	6.56	-28.78	Peak	10	Pass
NVNT	n40	5795	Ant3	5875	-44.35	6.56	-37.79	Average	10	Pass
NVNT	n40	5795	Ant3	5925	-45.19	6.56	-38.63	Peak	-27	Pass
NVNT	n40	5795	Ant3	5925	-52.93	6.56	-46.37	Average	-27	Pass
NVNT	ac20	5745	Ant3	5650	-49.12	6.56	-42.56	Peak	-27	Pass
NVNT	ac20	5745	Ant3	5650	-56.41	6.56	-49.85	Average	-27	Pass
NVNT	ac20	5745	Ant3	5700	-34.21	6.56	-27.65	Peak	10	Pass
NVNT	ac20	5745	Ant3	5700	-43.26	6.56	-36.7	Average	10	Pass
NVNT	ac20	5745	Ant3	5720	-23.51	6.56	-16.95	Peak	15.6	Pass
NVNT	ac20	5745	Ant3	5720	-32.16	6.56	-25.6	Average	15.6	Pass
NVNT	ac20	5745	Ant3	5725	-16.2	6.56	-9.64	Peak	27	Pass
NVNT	ac20	5745	Ant3	5725	-23.71	6.56	-17.15	Average	27	Pass
NVNT	ac20	5825	Ant3	5850	-24.55	6.56	-17.99	Peak	27	Pass
NVNT	ac20	5825	Ant3	5850	-32.34	6.56	-25.78	Average	27	Pass
NVNT	ac20	5825	Ant3	5855	-29.8	6.56	-23.24	Peak	15.6	Pass
NVNT	ac20	5825	Ant3	5855	-37.39	6.56	-30.83	Average	15.6	Pass
NVNT	ac20	5825	Ant3	5875	-37.79	6.56	-31.23	Peak	10	Pass
NVNT	ac20	5825	Ant3	5875	-48.13	6.56	-41.57	Average	10	Pass
NVNT	ac20	5825	Ant3	5925	-49.36	6.56	-42.8	Peak	-27	Pass
NVNT	ac20	5825	Ant3	5925	-56.4	6.56	-49.84	Average	-27	Pass
NVNT	ac40	5755	Ant3	5650	-36.75	6.56	-30.19	Peak	-27	Pass
NVNT	ac40	5755	Ant3	5650	-45.15	6.56	-38.59	Average	-27	Pass
NVNT	ac40	5755	Ant3	5700	-27.23	6.56	-20.67	Peak	10	Pass
NVNT	ac40	5755	Ant3	5700	-33.8	6.56	-27.24	Average	10	Pass
NVNT	ac40	5755	Ant3	5720	-12.62	6.56	-6.06	Peak	15.6	Pass
NVNT	ac40	5755	Ant3	5720	-21.9	6.56	-15.34	Average	15.6	Pass
NVNT	ac40	5755	Ant3	5725	-12	6.56	-5.44	Peak	27	Pass
NVNT	ac40	5755	Ant3	5725	-20.82	6.56	-14.26	Average	27	Pass
NVNT	ac40	5795	Ant3	5850	-19.33	6.56	-12.77	Peak	27	Pass
NVNT	ac40	5795	Ant3	5850	-31.3	6.56	-24.74	Average	27	Pass
NVNT	ac40	5795	Ant3	5855	-26.06	6.56	-19.5	Peak	15.6	Pass
NVNT	ac40	5795	Ant3	5855	-33.55	6.56	-26.99	Average	15.6	Pass
NVNT	ac40	5795	Ant3	5875	-36.19	6.56	-29.63	Peak	10	Pass
NVNT	ac40	5795	Ant3	5875	-43.37	6.56	-36.81	Average	10	Pass
NVNT	ac40	5795	Ant3	5925	-44.89	6.56	-38.33	Peak	-27	Pass
NVNT	ac40	5795	Ant3	5925	-51.39	6.56	-44.83	Average	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	Ant3	5850	-21.54	6.56	-14.98	Peak	27	Pass
NVNT	ac80	5775	Ant3	5850	-27.22	6.56	-20.66	Average	27	Pass
NVNT	ac80	5775	Ant3	5855	-23.75	6.56	-17.19	Peak	15.6	Pass
NVNT	ac80	5775	Ant3	5855	-28.85	6.56	-22.29	Average	15.6	Pass
NVNT	ac80	5775	Ant3	5875	-29.92	6.56	-23.36	Peak	10	Pass
NVNT	ac80	5775	Ant3	5875	-37.08	6.56	-30.52	Average	10	Pass
NVNT	ac80	5775	Ant3	5925	-44.3	6.56	-37.74	Peak	-27	Pass
NVNT	ac80	5775	Ant3	5925	-48.07	6.56	-41.51	Average	-27	Pass
NVNT	ac80	5775	Ant3	5650	-37.52	6.56	-30.96	Peak	-27	Pass
NVNT	ac80	5775	Ant3	5650	-41.55	6.56	-34.99	Average	-27	Pass
NVNT	ac80	5775	Ant3	5700	-24.67	6.56	-18.11	Peak	10	Pass
NVNT	ac80	5775	Ant3	5700	-30.42	6.56	-23.86	Average	10	Pass
NVNT	ac80	5775	Ant3	5720	-18.73	6.56	-12.17	Peak	15.6	Pass
NVNT	ac80	5775	Ant3	5720	-24.33	6.56	-17.77	Average	15.6	Pass
NVNT	ac80	5775	Ant3	5725	-18.93	6.56	-12.37	Peak	27	Pass
NVNT	ac80	5775	Ant3	5725	-24.81	6.56	-18.25	Average	27	Pass
NVNT	ax20	5745	Ant3	5650	-44	6.56	-37.44	Peak	-27	Pass
NVNT	ax20	5745	Ant3	5650	-56.51	6.56	-49.95	Average	-27	Pass
NVNT	ax20	5745	Ant3	5700	-33.03	6.56	-26.47	Peak	10	Pass
NVNT	ax20	5745	Ant3	5700	-39.96	6.56	-33.4	Average	10	Pass
NVNT	ax20	5745	Ant3	5720	-17.95	6.56	-11.39	Peak	15.6	Pass
NVNT	ax20	5745	Ant3	5720	-25.11	6.56	-18.55	Average	15.6	Pass
NVNT	ax20	5745	Ant3	5725	-11.25	6.56	-4.69	Peak	27	Pass
NVNT	ax20	5745	Ant3	5725	-19.53	6.56	-12.97	Average	27	Pass
NVNT	ax20	5825	Ant3	5850	-16.87	6.56	-10.31	Peak	27	Pass
NVNT	ax20	5825	Ant3	5850	-28.36	6.56	-21.8	Average	27	Pass
NVNT	ax20	5825	Ant3	5855	-27.98	6.56	-21.42	Peak	15.6	Pass
NVNT	ax20	5825	Ant3	5855	-35.48	6.56	-28.92	Average	15.6	Pass
NVNT	ax20	5825	Ant3	5875	-31.11	6.56	-24.55	Peak	10	Pass
NVNT	ax20	5825	Ant3	5875	-46.36	6.56	-39.8	Average	10	Pass
NVNT	ax20	5825	Ant3	5925	-49.08	6.56	-42.52	Peak	-27	Pass
NVNT	ax20	5825	Ant3	5925	-56.06	6.56	-49.5	Average	-27	Pass
NVNT	ax40	5755	Ant3	5650	-39.35	6.56	-32.79	Peak	-27	Pass
NVNT	ax40	5755	Ant3	5650	-44.75	6.56	-38.19	Average	-27	Pass
NVNT	ax40	5755	Ant3	5700	-25.13	6.56	-18.57	Peak	10	Pass
NVNT	ax40	5755	Ant3	5700	-34.43	6.56	-27.87	Average	10	Pass
NVNT	ax40	5755	Ant3	5720	-13.58	6.56	-7.02	Peak	15.6	Pass
NVNT	ax40	5755	Ant3	5720	-20.96	6.56	-14.4	Average	15.6	Pass
NVNT	ax40	5755	Ant3	5725	-12.44	6.56	-5.88	Peak	27	Pass
NVNT	ax40	5755	Ant3	5725	-19.26	6.56	-12.7	Average	27	Pass
NVNT	ax40	5795	Ant3	5850	-22.02	6.56	-15.46	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5795	Ant3	5850	-33.3	6.56	-26.74	Average	27	Pass
NVNT	ax40	5795	Ant3	5855	-26.81	6.56	-20.25	Peak	15.6	Pass
NVNT	ax40	5795	Ant3	5855	-35.63	6.56	-29.07	Average	15.6	Pass
NVNT	ax40	5795	Ant3	5875	-38.04	6.56	-31.48	Peak	10	Pass
NVNT	ax40	5795	Ant3	5875	-43.58	6.56	-37.02	Average	10	Pass
NVNT	ax40	5795	Ant3	5925	-45.01	6.56	-38.45	Peak	-27	Pass
NVNT	ax40	5795	Ant3	5925	-52.19	6.56	-45.63	Average	-27	Pass
NVNT	ax80	5775	Ant3	5850	-19.45	6.56	-12.89	Peak	27	Pass
NVNT	ax80	5775	Ant3	5850	-27.33	6.56	-20.77	Average	27	Pass
NVNT	ax80	5775	Ant3	5855	-21.21	6.56	-14.65	Peak	15.6	Pass
NVNT	ax80	5775	Ant3	5855	-28.96	6.56	-22.4	Average	15.6	Pass
NVNT	ax80	5775	Ant3	5875	-28.72	6.56	-22.16	Peak	10	Pass
NVNT	ax80	5775	Ant3	5875	-36.26	6.56	-29.7	Average	10	Pass
NVNT	ax80	5775	Ant3	5925	-41.02	6.56	-34.46	Peak	-27	Pass
NVNT	ax80	5775	Ant3	5925	-47.23	6.56	-40.67	Average	-27	Pass
NVNT	ax80	5775	Ant3	5650	-35.21	6.56	-28.65	Peak	-27	Pass
NVNT	ax80	5775	Ant3	5650	-40.47	6.56	-33.91	Average	-27	Pass
NVNT	ax80	5775	Ant3	5700	-20.03	6.56	-13.47	Peak	10	Pass
NVNT	ax80	5775	Ant3	5700	-28.75	6.56	-22.19	Average	10	Pass
NVNT	ax80	5775	Ant3	5720	-17.99	6.56	-11.43	Peak	15.6	Pass
NVNT	ax80	5775	Ant3	5720	-25	6.56	-18.44	Average	15.6	Pass
NVNT	ax80	5775	Ant3	5725	-19.01	6.56	-12.45	Peak	27	Pass
NVNT	ax80	5775	Ant3	5725	-24.67	6.56	-18.11	Average	27	Pass
NVNT	be20	5745	Ant3	5650	-47.49	6.56	-40.93	Peak	-27	Pass
NVNT	be20	5745	Ant3	5650	-54.37	6.56	-47.81	Average	-27	Pass
NVNT	be20	5745	Ant3	5700	-30.81	6.56	-24.25	Peak	10	Pass
NVNT	be20	5745	Ant3	5700	-39.97	6.56	-33.41	Average	10	Pass
NVNT	be20	5745	Ant3	5720	-15.96	6.56	-9.4	Peak	15.6	Pass
NVNT	be20	5745	Ant3	5720	-25.56	6.56	-19	Average	15.6	Pass
NVNT	be20	5745	Ant3	5725	-10.6	6.56	-4.04	Peak	27	Pass
NVNT	be20	5745	Ant3	5725	-19.28	6.56	-12.72	Average	27	Pass
NVNT	be20	5825	Ant3	5850	-18.3	6.56	-11.74	Peak	27	Pass
NVNT	be20	5825	Ant3	5850	-28.29	6.56	-21.73	Average	27	Pass
NVNT	be20	5825	Ant3	5855	-26.19	6.56	-19.63	Peak	15.6	Pass
NVNT	be20	5825	Ant3	5855	-33.55	6.56	-26.99	Average	15.6	Pass
NVNT	be20	5825	Ant3	5875	-36.47	6.56	-29.91	Peak	10	Pass
NVNT	be20	5825	Ant3	5875	-45.42	6.56	-38.86	Average	10	Pass
NVNT	be20	5825	Ant3	5925	-50.1	6.56	-43.54	Peak	-27	Pass
NVNT	be20	5825	Ant3	5925	-55.73	6.56	-49.17	Average	-27	Pass
NVNT	be40	5755	Ant3	5650	-38.57	6.56	-32.01	Peak	-27	Pass
NVNT	be40	5755	Ant3	5650	-45.08	6.56	-38.52	Average	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be40	5755	Ant3	5700	-26.67	6.56	-20.11	Peak	10	Pass
NVNT	be40	5755	Ant3	5700	-35.38	6.56	-28.82	Average	10	Pass
NVNT	be40	5755	Ant3	5720	-16.32	6.56	-9.76	Peak	15.6	Pass
NVNT	be40	5755	Ant3	5720	-23.04	6.56	-16.48	Average	15.6	Pass
NVNT	be40	5755	Ant3	5725	-14.25	6.56	-7.69	Peak	27	Pass
NVNT	be40	5755	Ant3	5725	-21.3	6.56	-14.74	Average	27	Pass
NVNT	be40	5795	Ant3	5850	-26.3	6.56	-19.74	Peak	27	Pass
NVNT	be40	5795	Ant3	5850	-32.33	6.56	-25.77	Average	27	Pass
NVNT	be40	5795	Ant3	5855	-25.78	6.56	-19.22	Peak	15.6	Pass
NVNT	be40	5795	Ant3	5855	-35.18	6.56	-28.62	Average	15.6	Pass
NVNT	be40	5795	Ant3	5875	-36.13	6.56	-29.57	Peak	10	Pass
NVNT	be40	5795	Ant3	5875	-43.6	6.56	-37.04	Average	10	Pass
NVNT	be40	5795	Ant3	5925	-44.52	6.56	-37.96	Peak	-27	Pass
NVNT	be40	5795	Ant3	5925	-51.47	6.56	-44.91	Average	-27	Pass
NVNT	be80	5775	Ant3	5850	-18.48	6.56	-11.92	Peak	27	Pass
NVNT	be80	5775	Ant3	5850	-27.28	6.56	-20.72	Average	27	Pass
NVNT	be80	5775	Ant3	5855	-21.56	6.56	-15	Peak	15.6	Pass
NVNT	be80	5775	Ant3	5855	-28.81	6.56	-22.25	Average	15.6	Pass
NVNT	be80	5775	Ant3	5875	-29.71	6.56	-23.15	Peak	10	Pass
NVNT	be80	5775	Ant3	5875	-36.36	6.56	-29.8	Average	10	Pass
NVNT	be80	5775	Ant3	5925	-41.17	6.56	-34.61	Peak	-27	Pass
NVNT	be80	5775	Ant3	5925	-47.63	6.56	-41.07	Average	-27	Pass
NVNT	be80	5775	Ant3	5650	-34.46	6.56	-27.9	Peak	-27	Pass
NVNT	be80	5775	Ant3	5650	-40.88	6.56	-34.32	Average	-27	Pass
NVNT	be80	5775	Ant3	5700	-22.65	6.56	-16.09	Peak	10	Pass
NVNT	be80	5775	Ant3	5700	-29.32	6.56	-22.76	Average	10	Pass
NVNT	be80	5775	Ant3	5720	-19.67	6.56	-13.11	Peak	15.6	Pass
NVNT	be80	5775	Ant3	5720	-25.76	6.56	-19.2	Average	15.6	Pass
NVNT	be80	5775	Ant3	5725	-18.9	6.56	-12.34	Peak	27	Pass
NVNT	be80	5775	Ant3	5725	-24.73	6.56	-18.17	Average	27	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

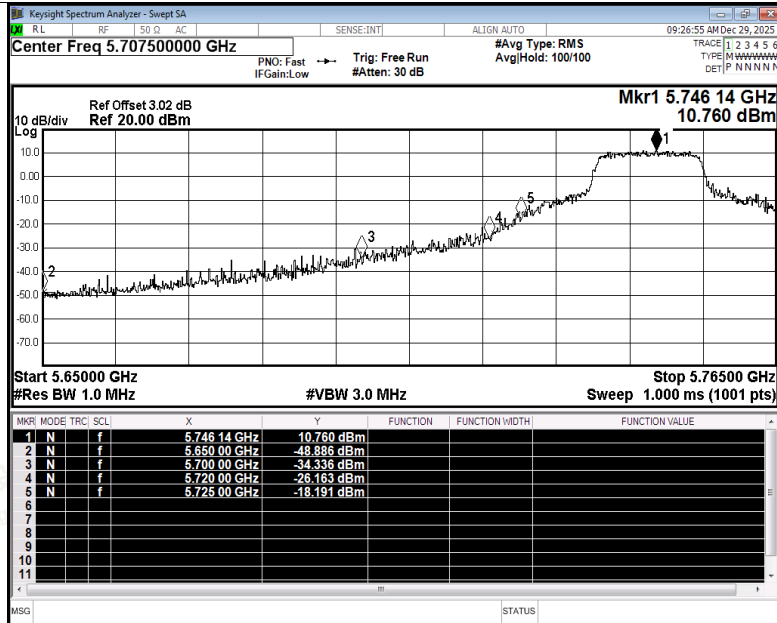

Restrict Band NVNT a 5745MHz Ant3 Peak

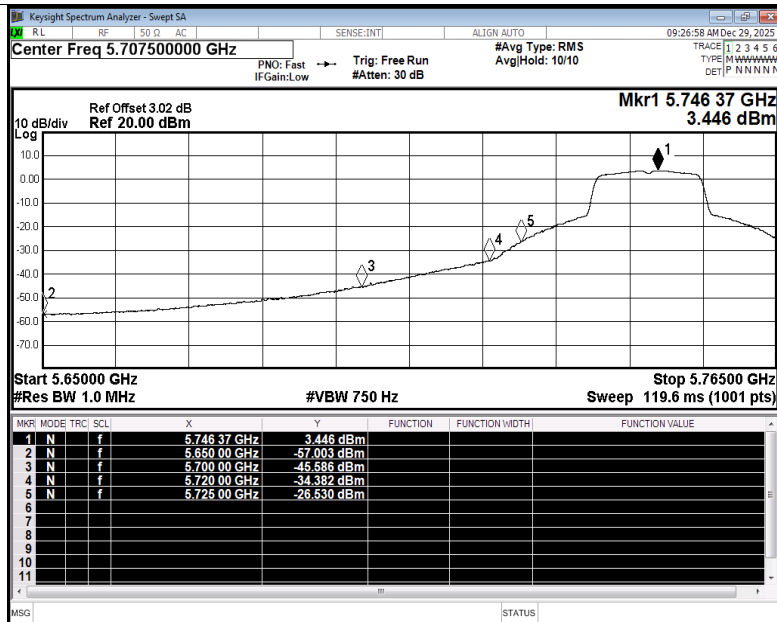

Restrict Band NVNT a 5745MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

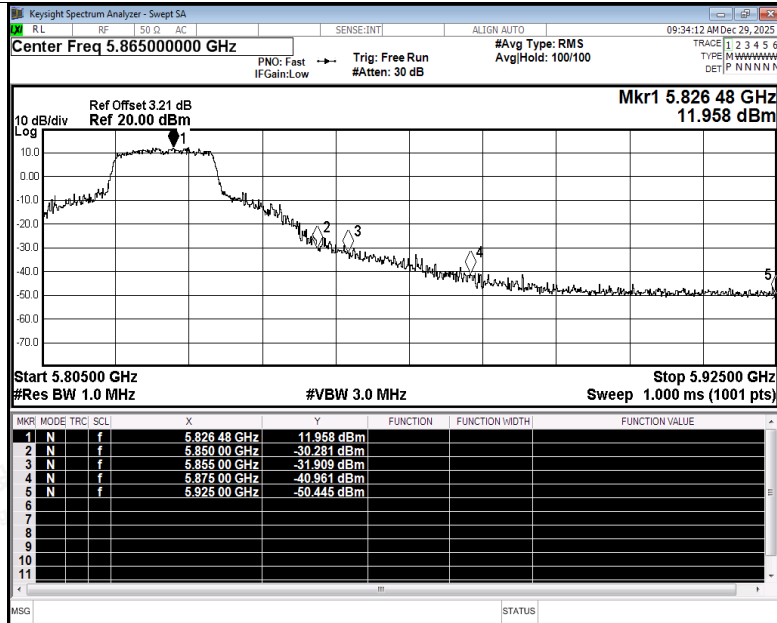

Restrict Band NVNT a 5825MHz Ant3 Peak

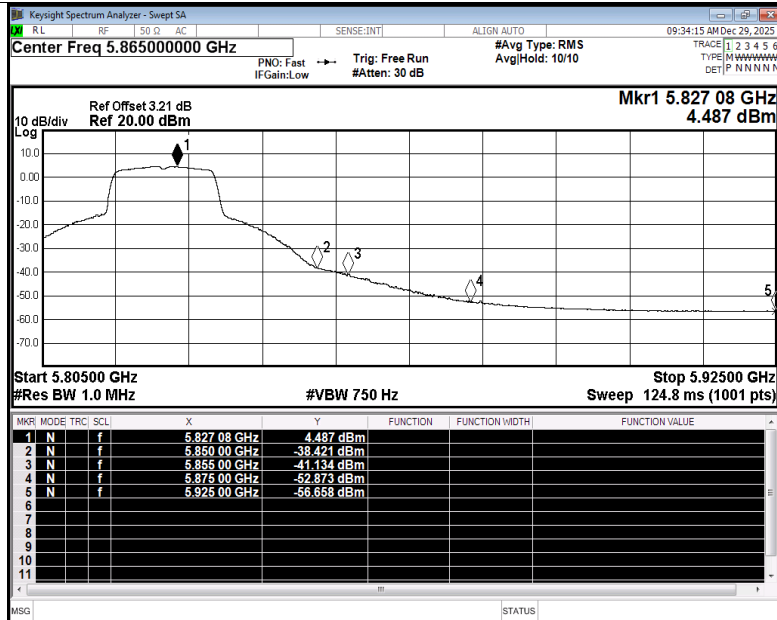

Restrict Band NVNT a 5825MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

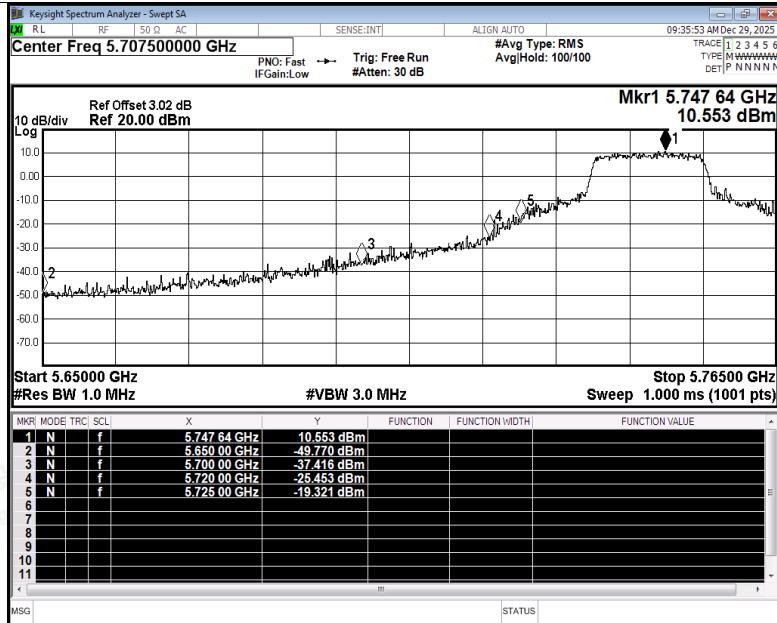

Restrict Band NVNT n20 5745MHz Ant3 Peak

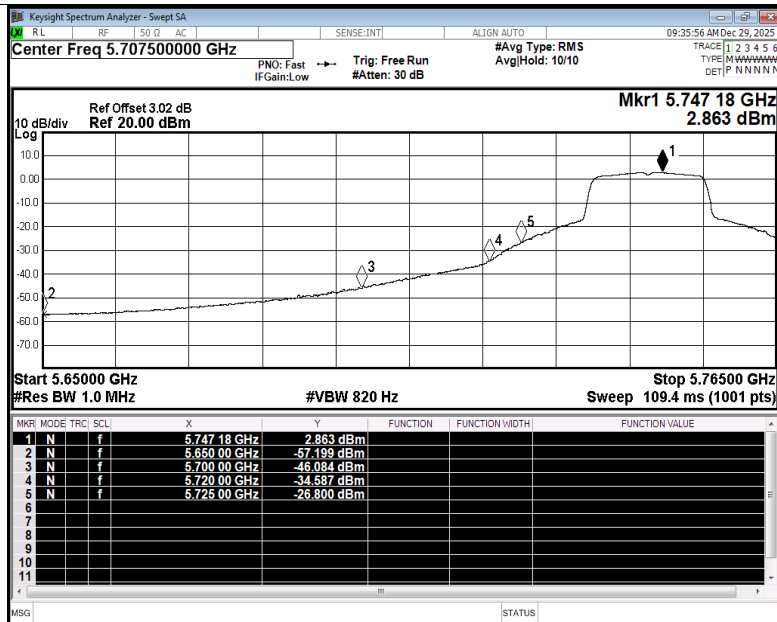

Restrict Band NVNT n20 5745MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

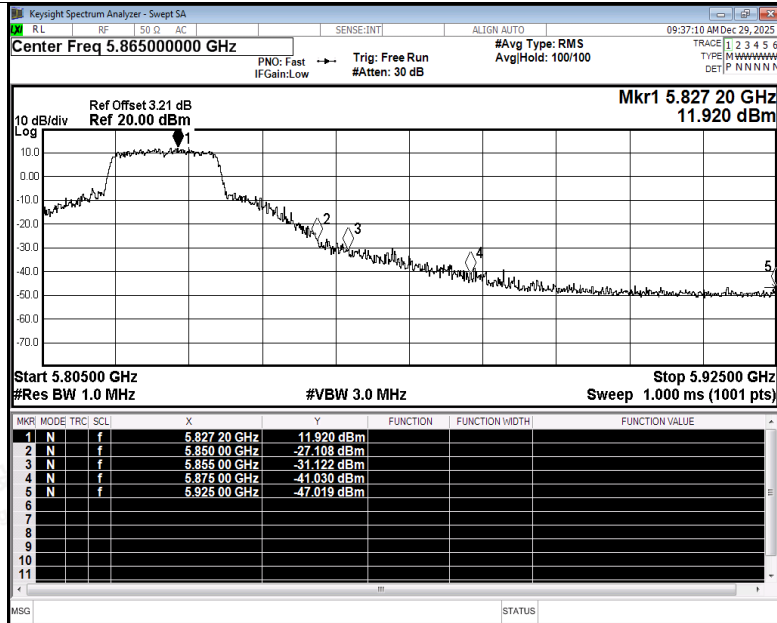

Restrict Band NVNT n20 5825MHz Ant3 Peak

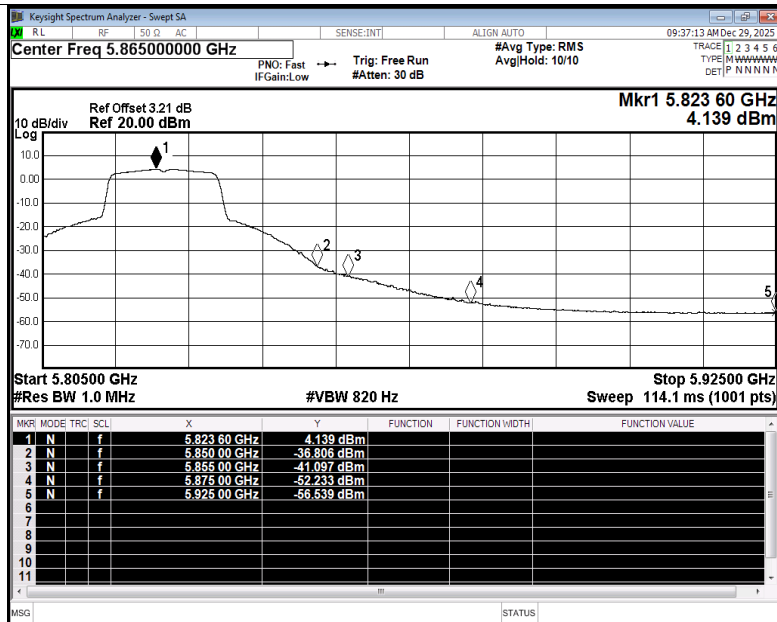

Restrict Band NVNT n20 5825MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

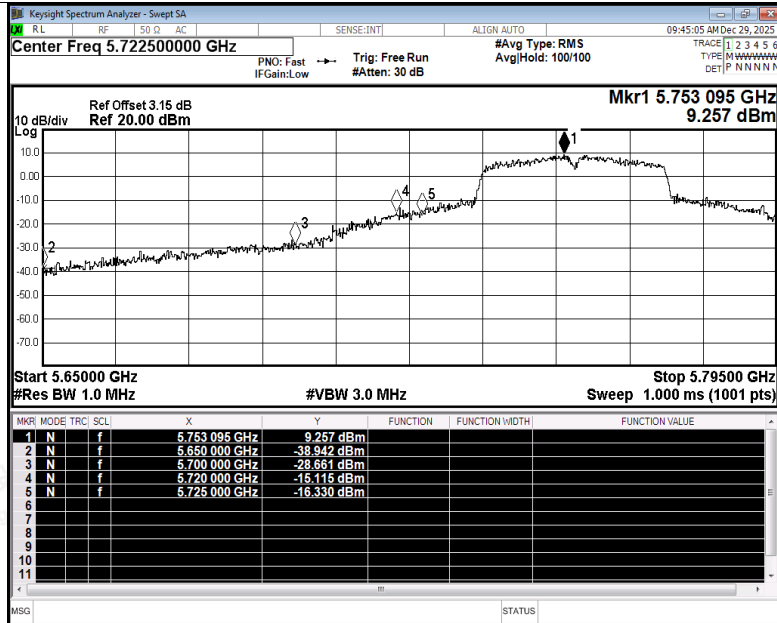

Restrict Band NVNT n40 5755MHz Ant3 Peak

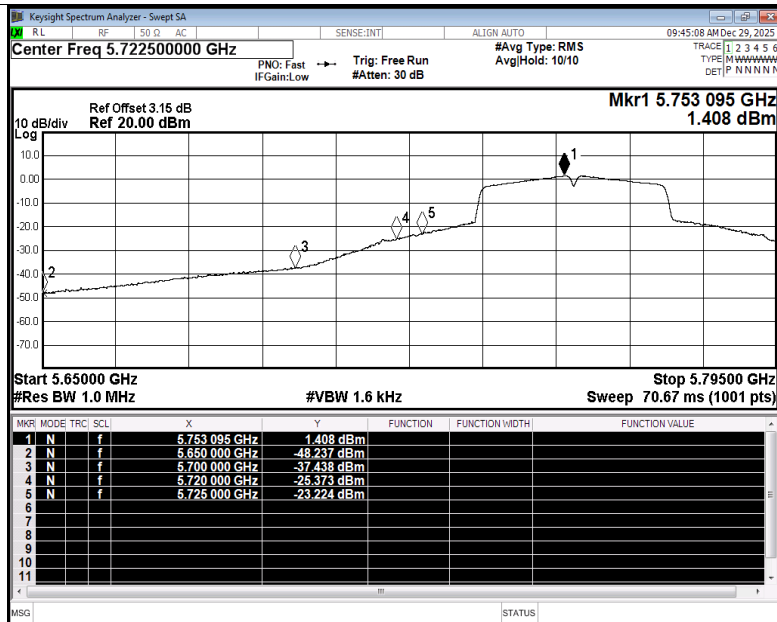

Restrict Band NVNT n40 5755MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

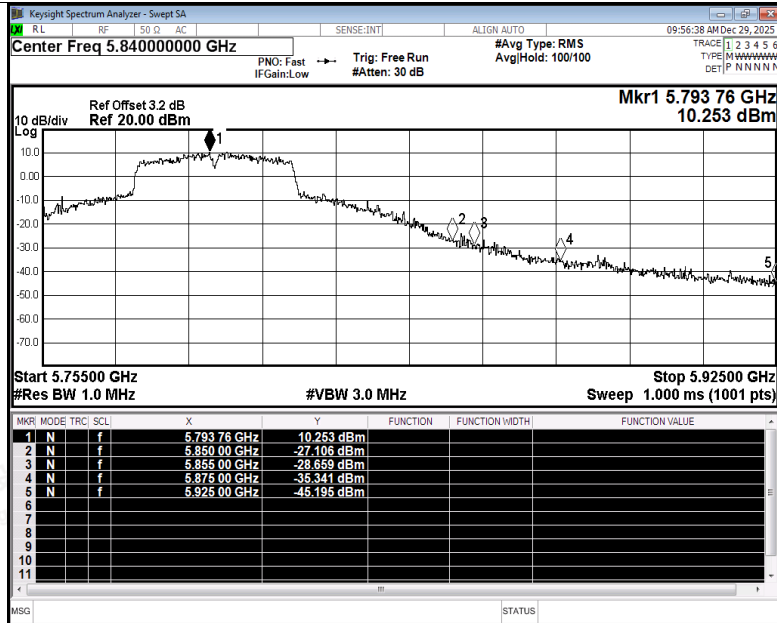

Restrict Band NVNT n40 5795MHz Ant3 Peak

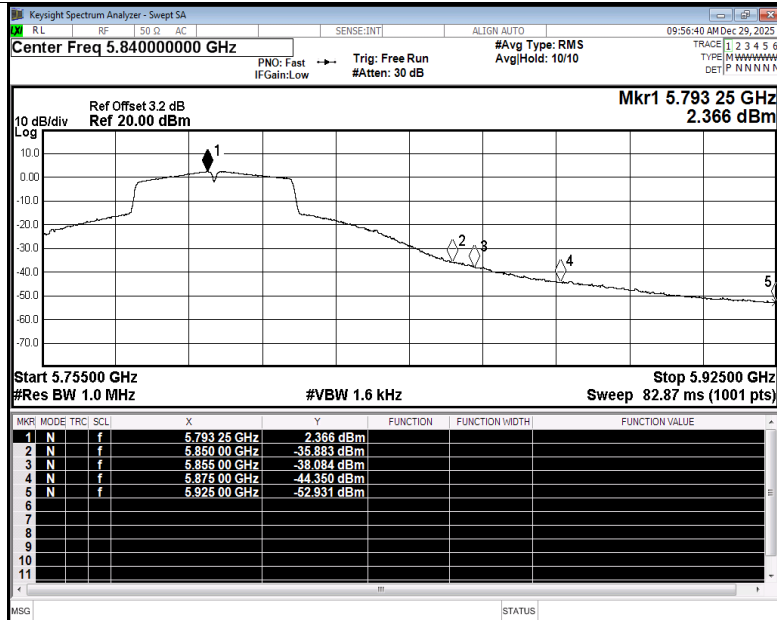

Restrict Band NVNT n40 5795MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

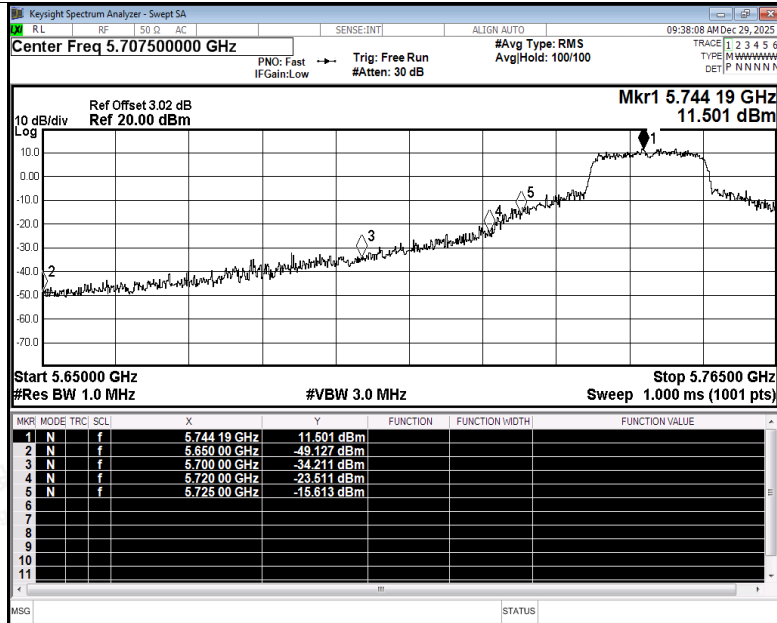

Restrict Band NVNT ac20 5745MHz Ant3 Peak

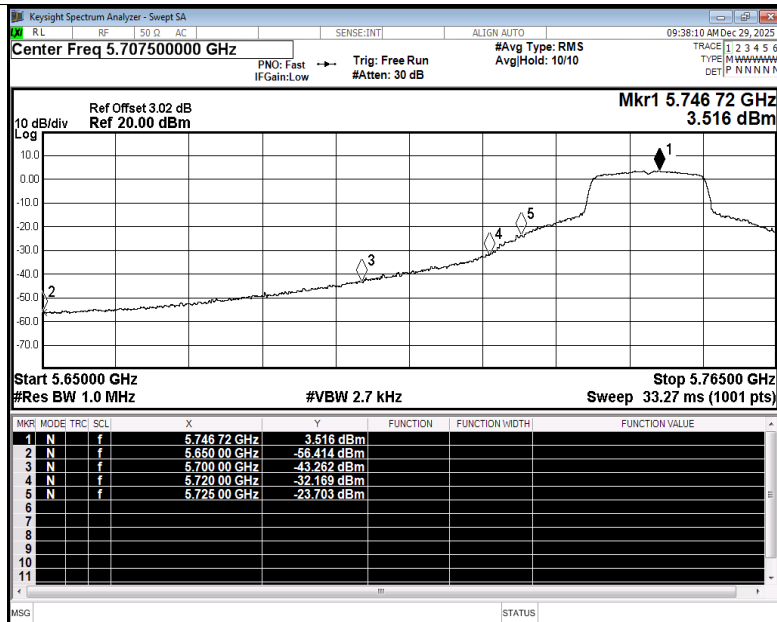

Restrict Band NVNT ac20 5745MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

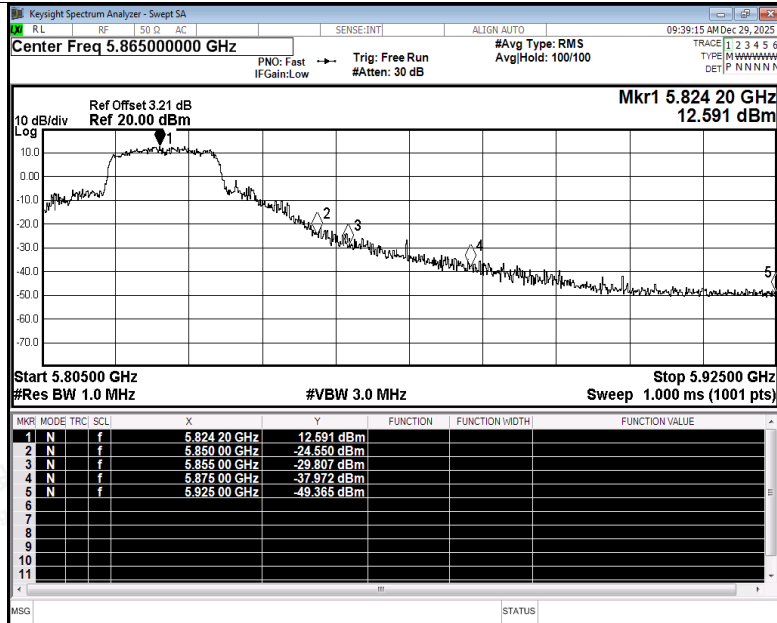

Restrict Band NVNT ac20 5825MHz Ant3 Peak

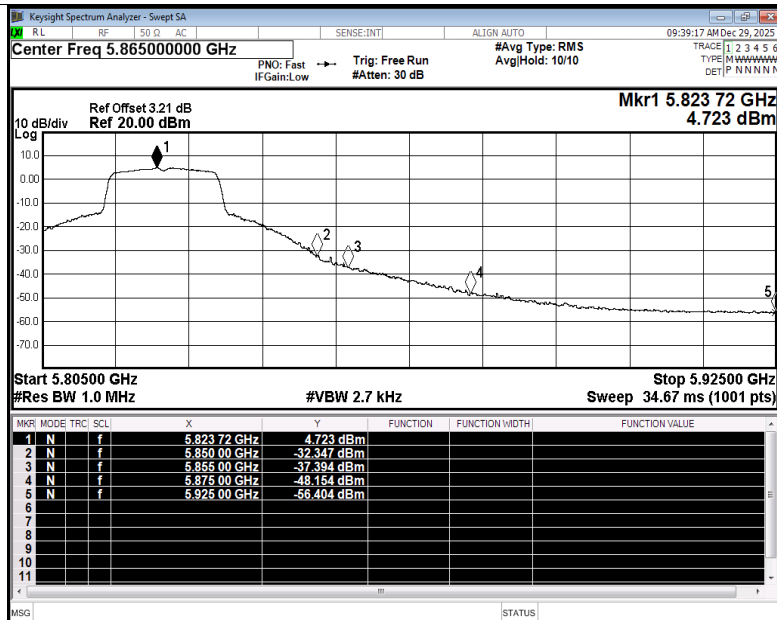

Restrict Band NVNT ac20 5825MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

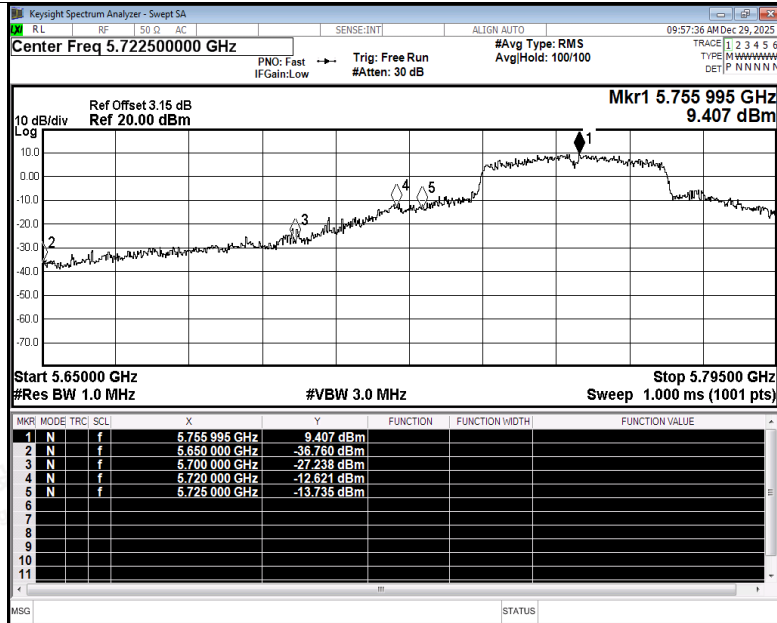

Restrict Band NVNT ac40 5755MHz Ant3 Peak

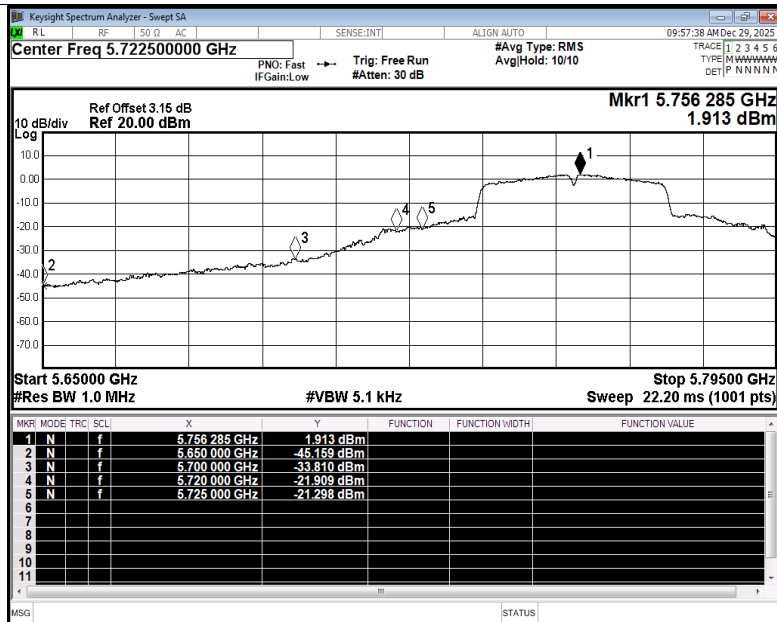

Restrict Band NVNT ac40 5755MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

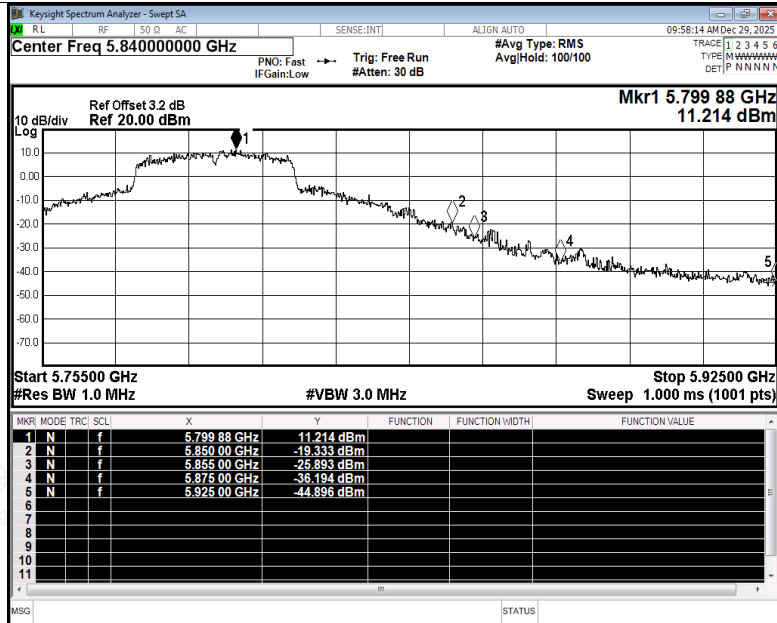

Restrict Band NVNT ac40 5795MHz Ant3 Peak

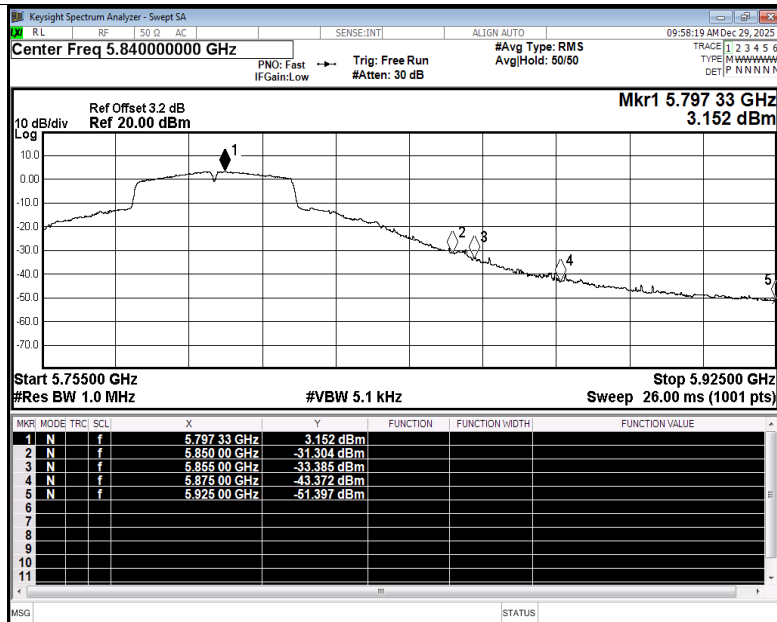

Restrict Band NVNT ac40 5795MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

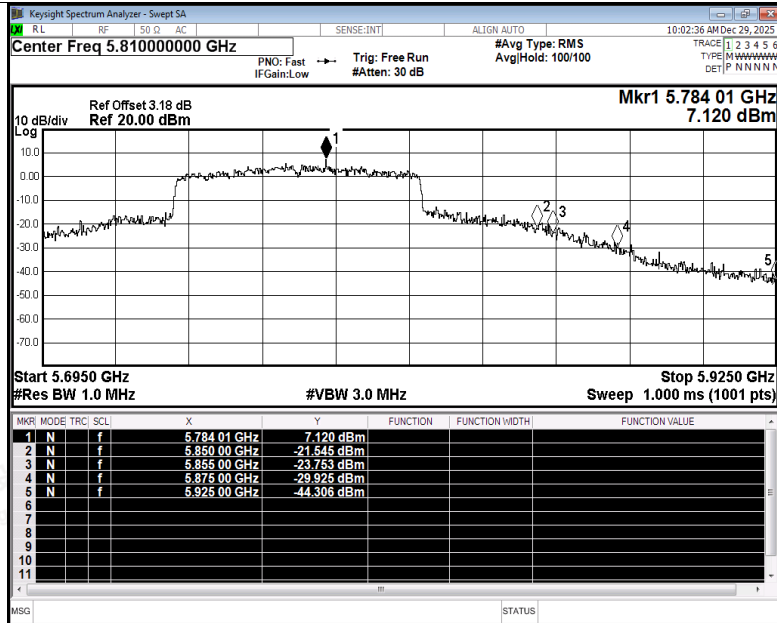

Restrict Band NVNT ac80 5775MHz Ant3 Peak

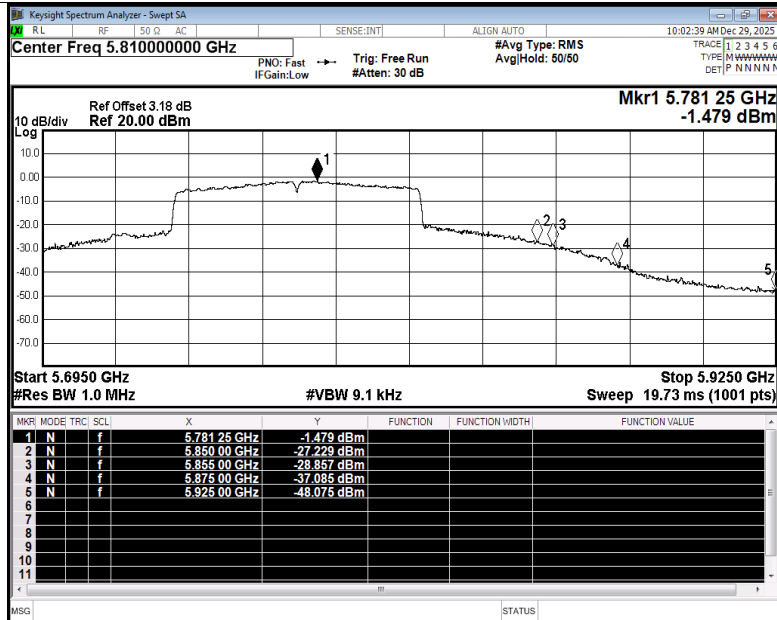

Restrict Band NVNT ac80 5775MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

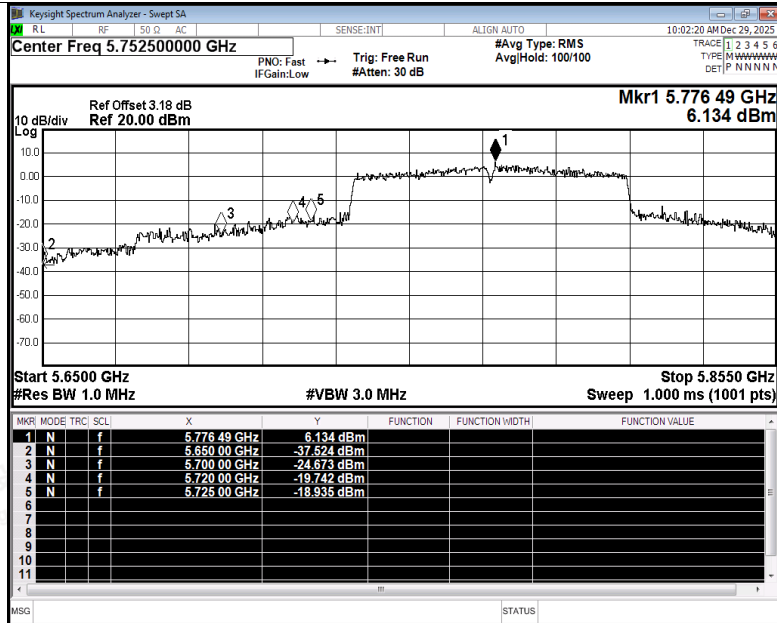

Restrict Band NVNT ac80 5775MHz Ant3 Peak

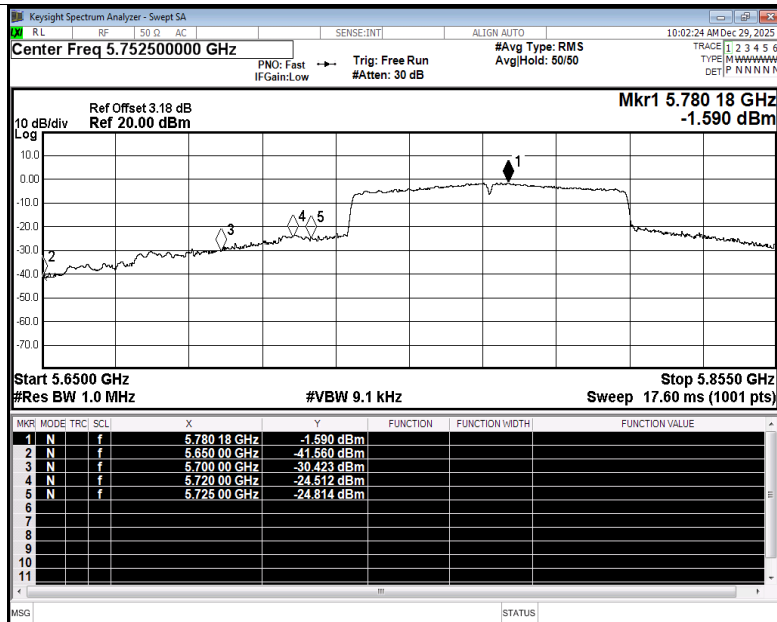

Restrict Band NVNT ac80 5775MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

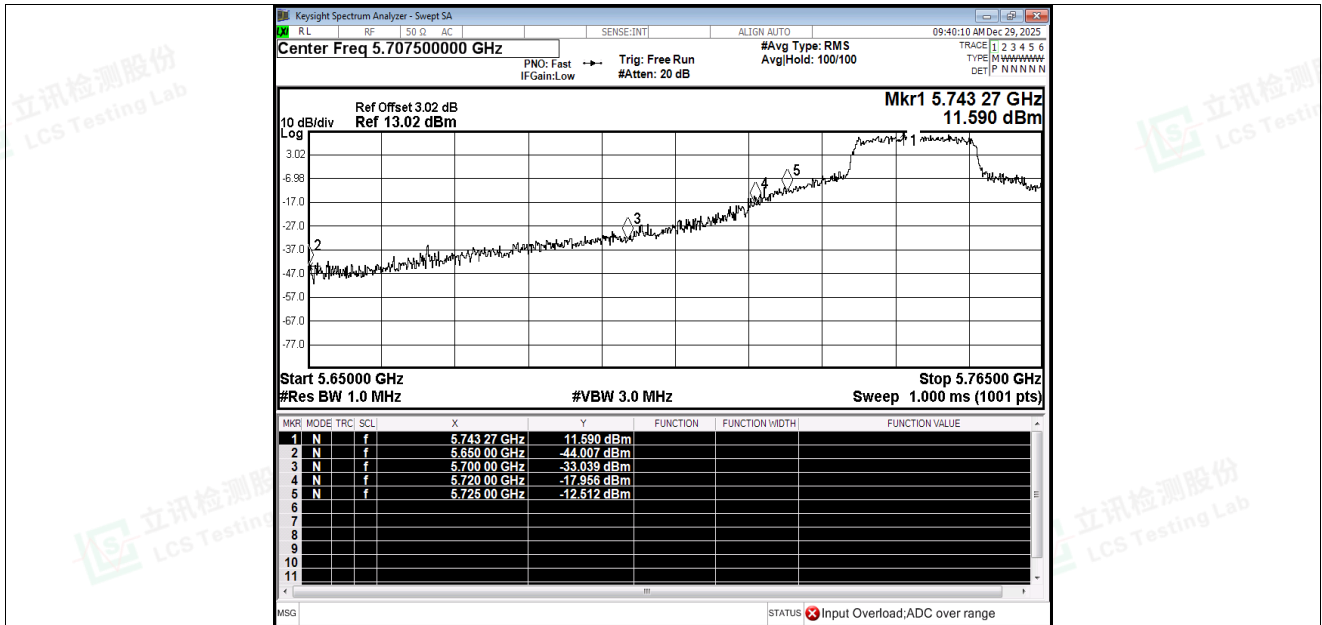

Restrict Band NVNT ax20 5745MHz Ant3 Peak

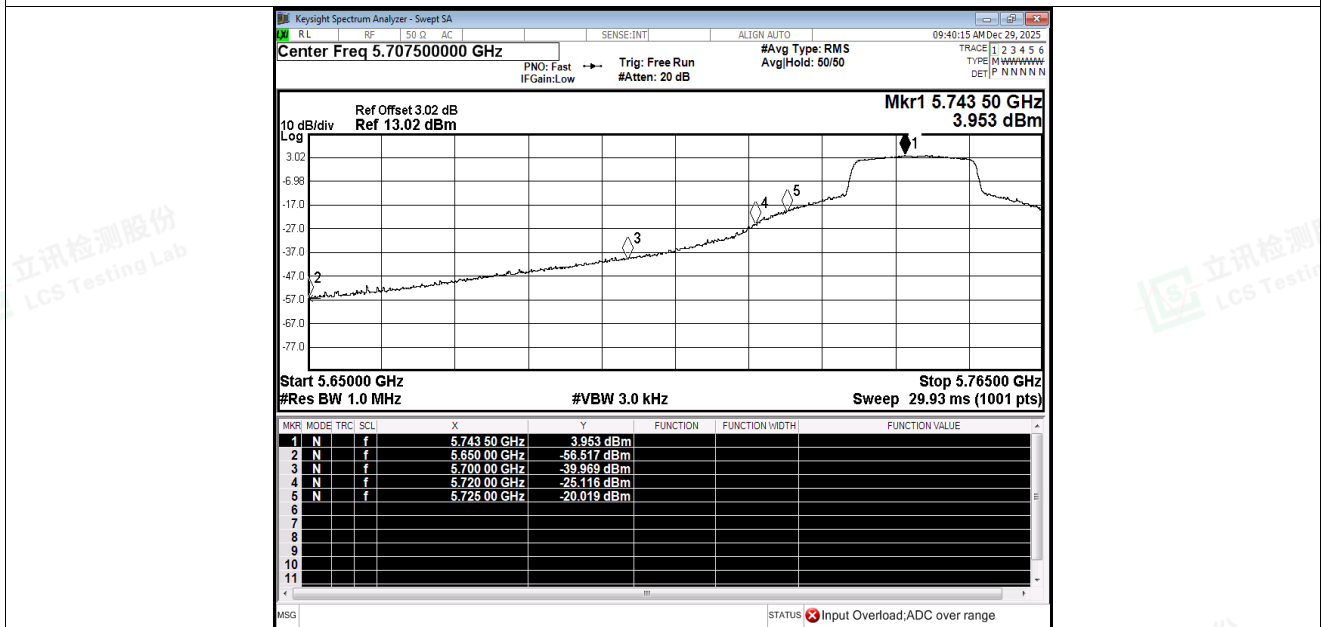

Restrict Band NVNT ax20 5745MHz Ant3 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

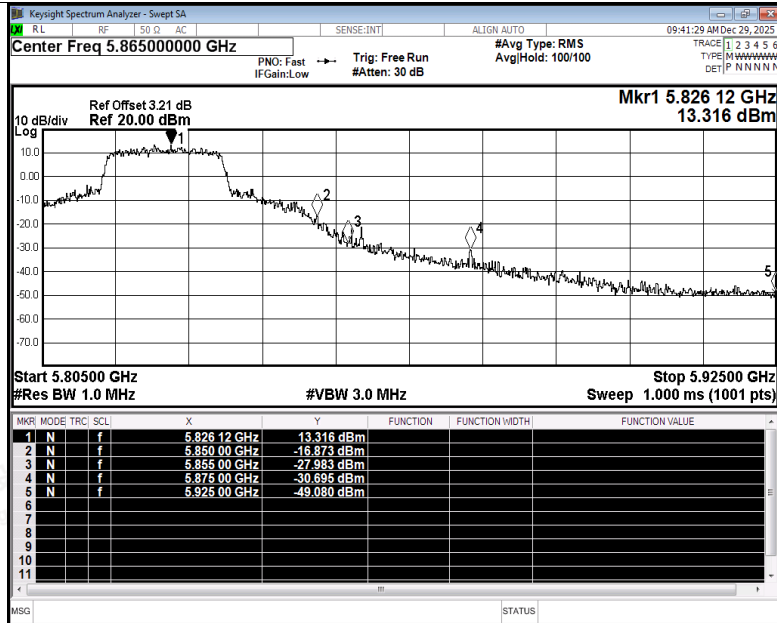

Restrict Band NVNT ax20 5825MHz Ant3 Peak

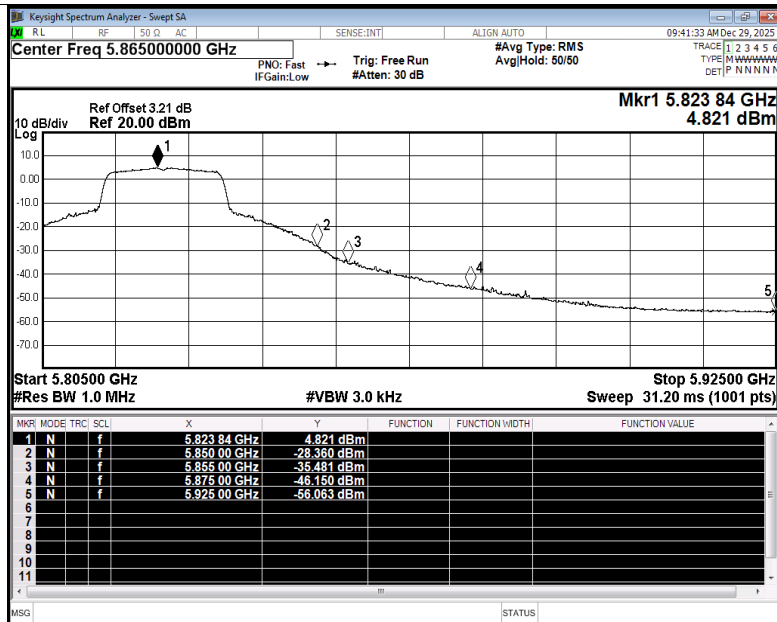

Restrict Band NVNT ax20 5825MHz Ant3 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity