





Restrict Band NVNT be80 5210MHz Ant4 Peak

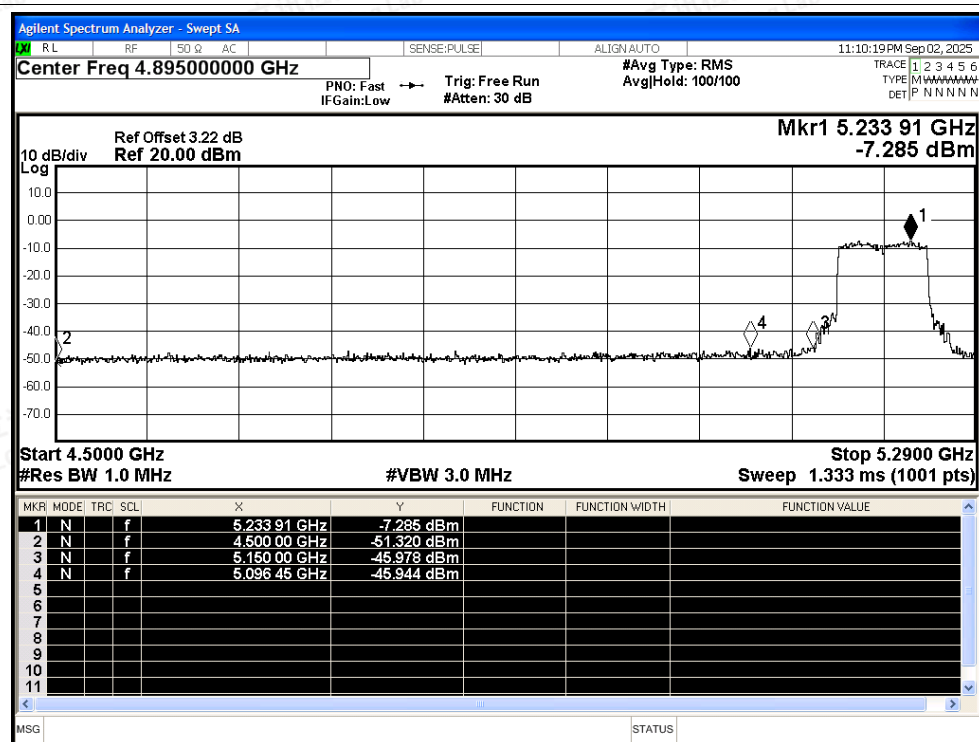

Restrict Band NVNT be80 5210MHz Ant4 Average

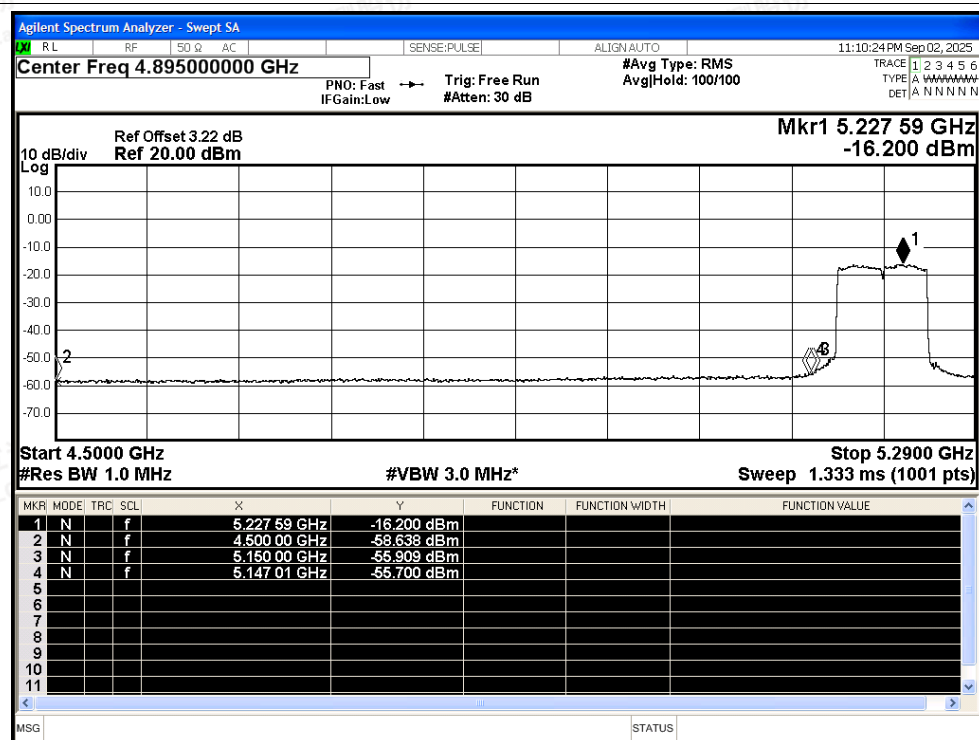

Restrict Band NVNT ac160 5250MHz Ant4 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

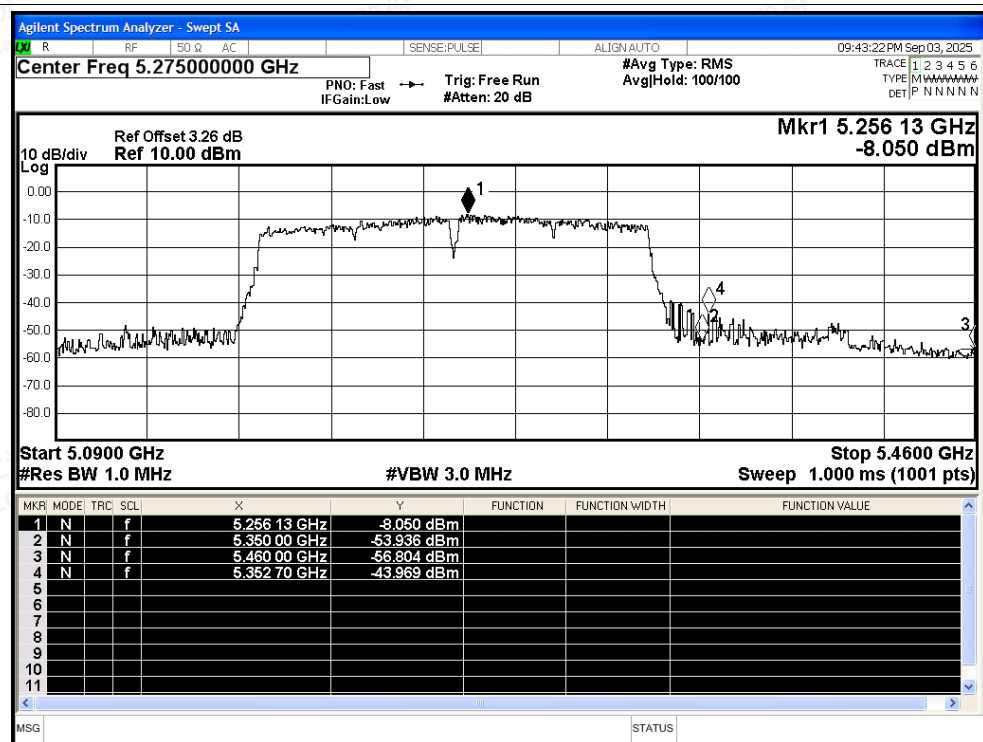


Restrict Band NVNT ac160 5250MHz Ant4 Average

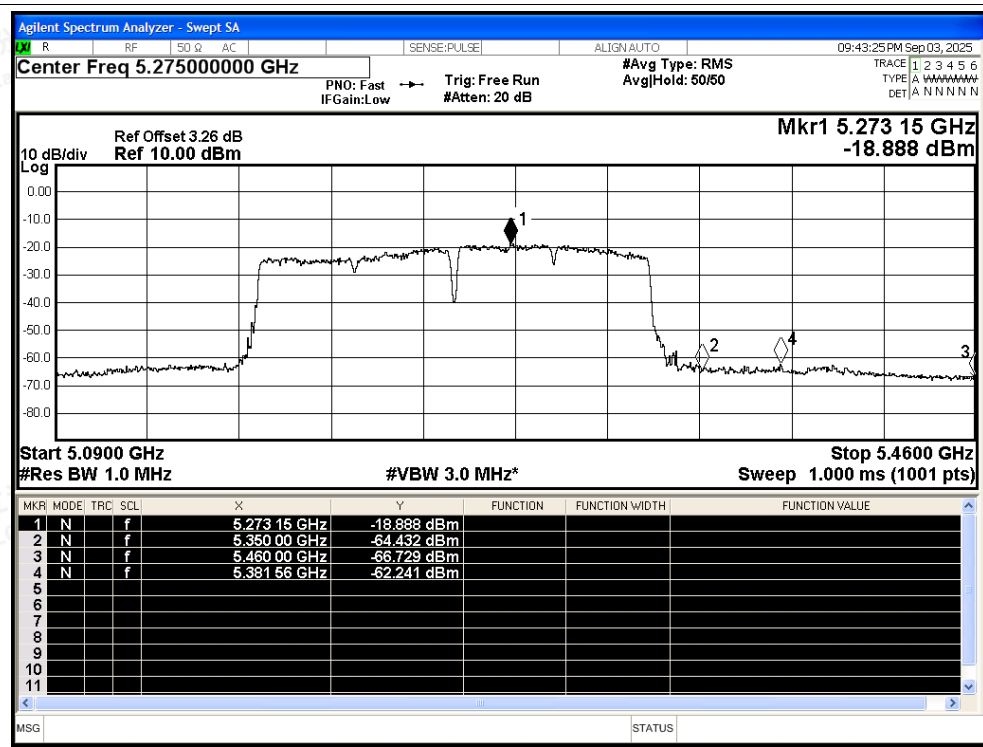




Restrict Band NVNT ac160 5250MHz Ant4 Peak

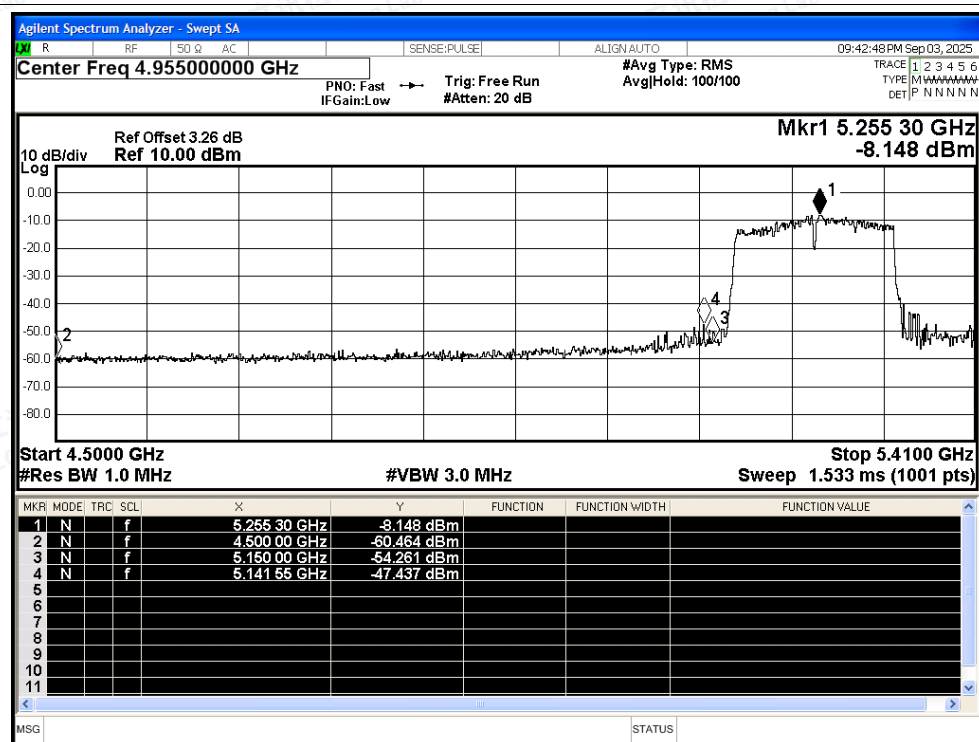

Restrict Band NVNT ac160 5250MHz Ant4 Average

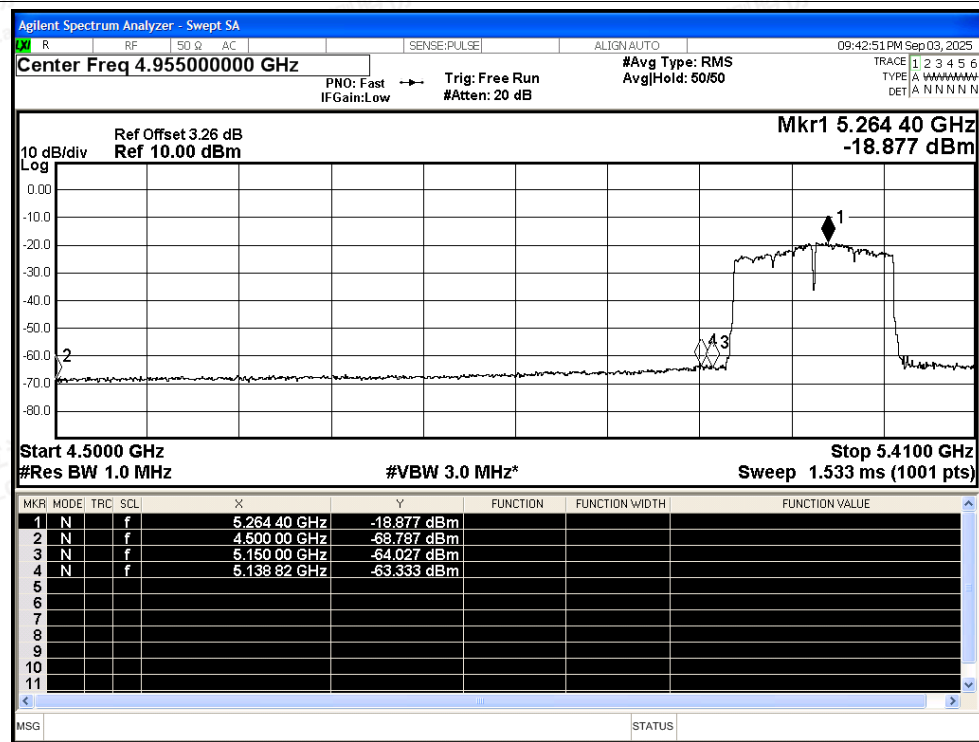

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant4 Peak

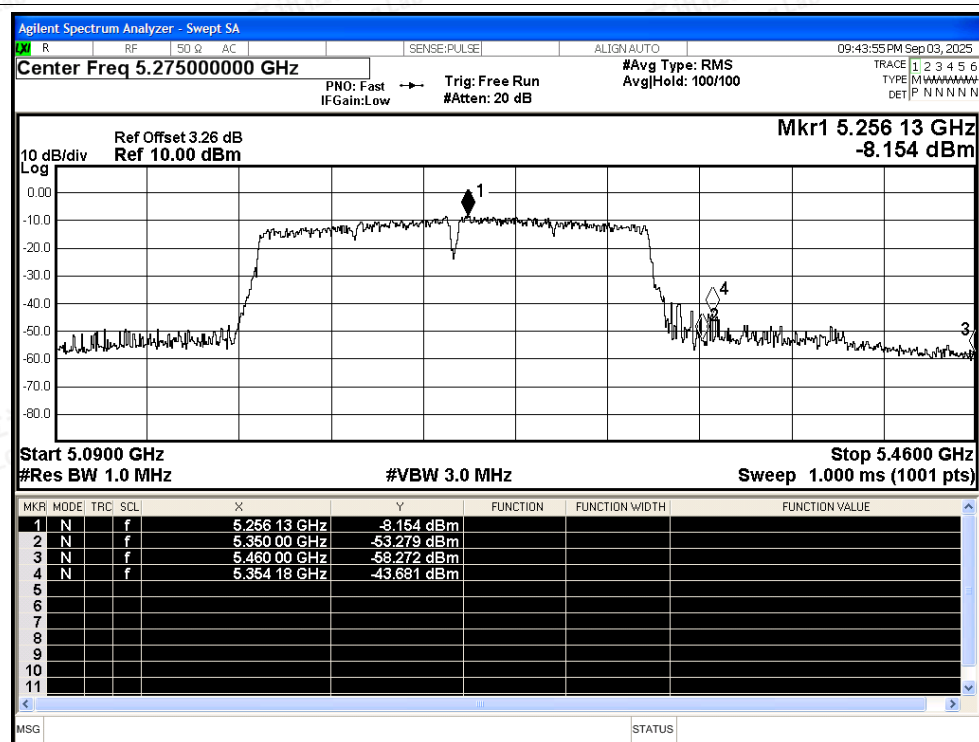


Restrict Band NVNT ax160 5250MHz Ant4 Average

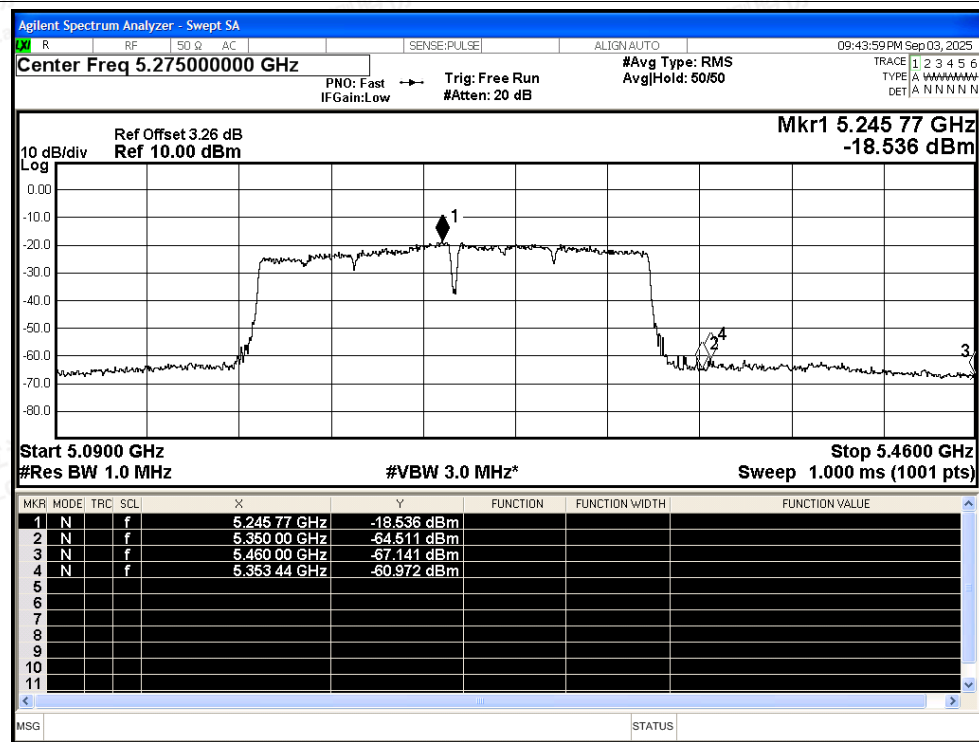




Restrict Band NVNT ax160 5250MHz Ant4 Peak

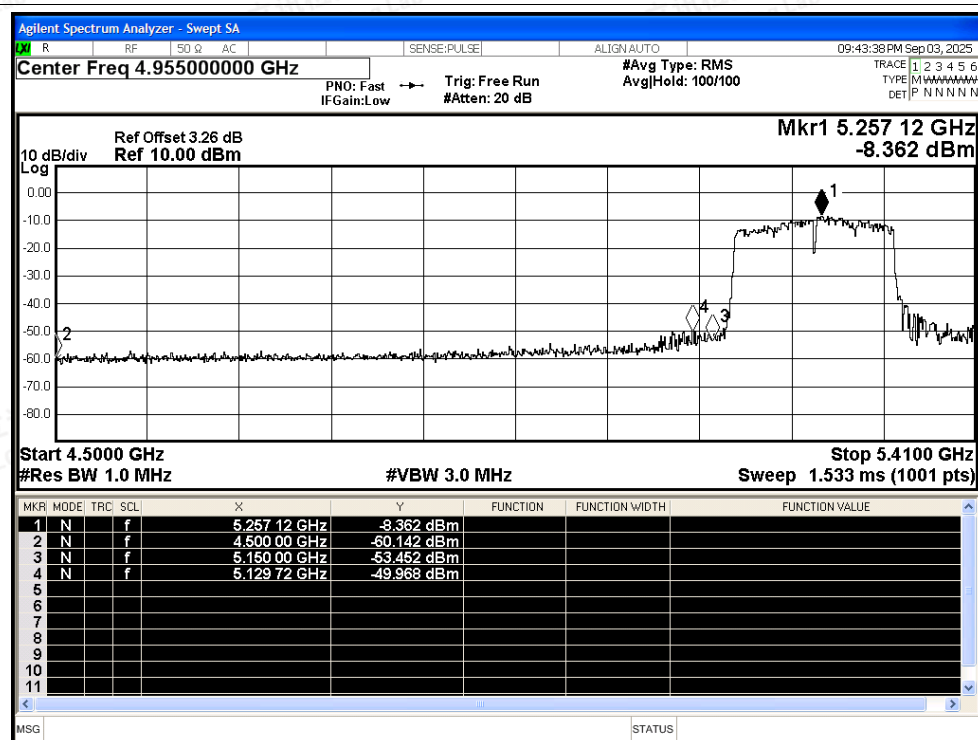

Restrict Band NVNT ax160 5250MHz Ant4 Average

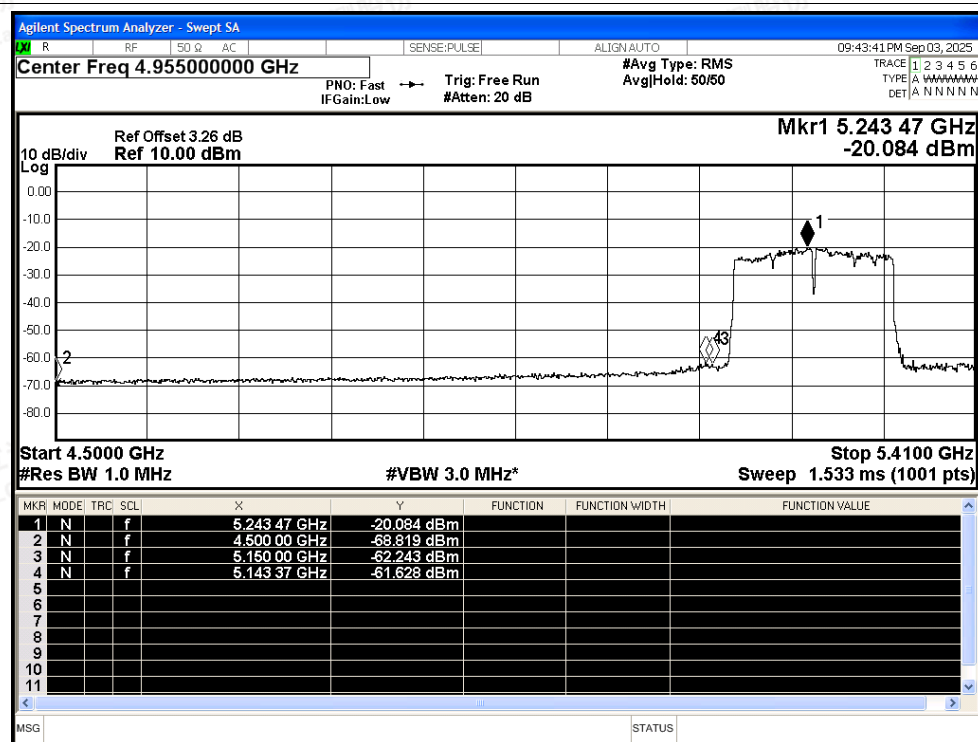

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be160 5250MHz Ant4 Peak

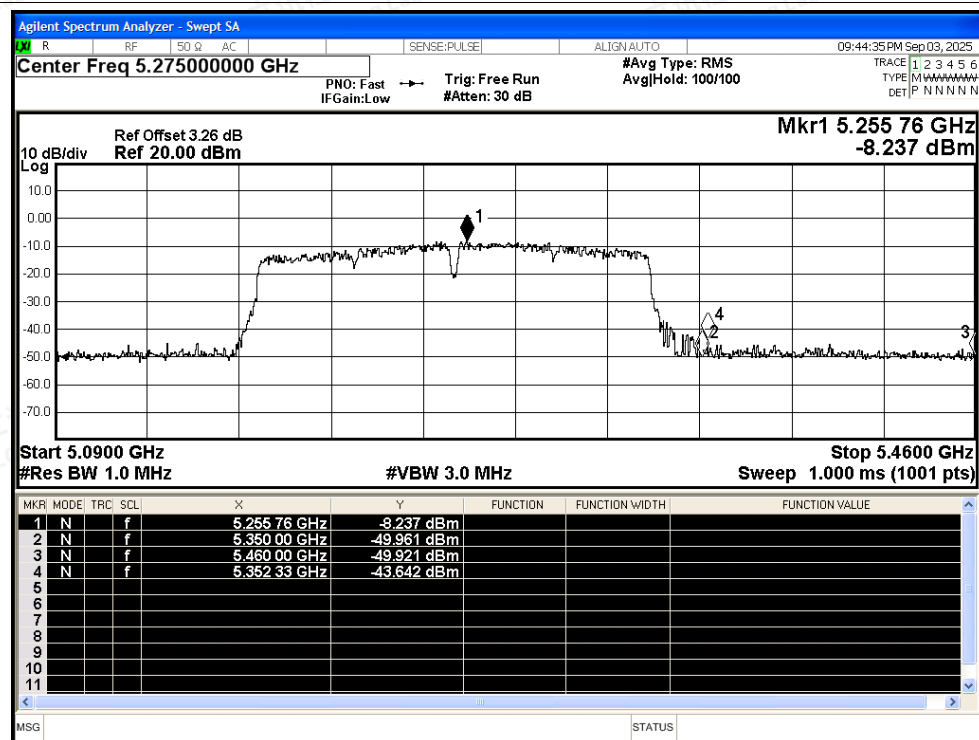


Restrict Band NVNT be160 5250MHz Ant4 Average

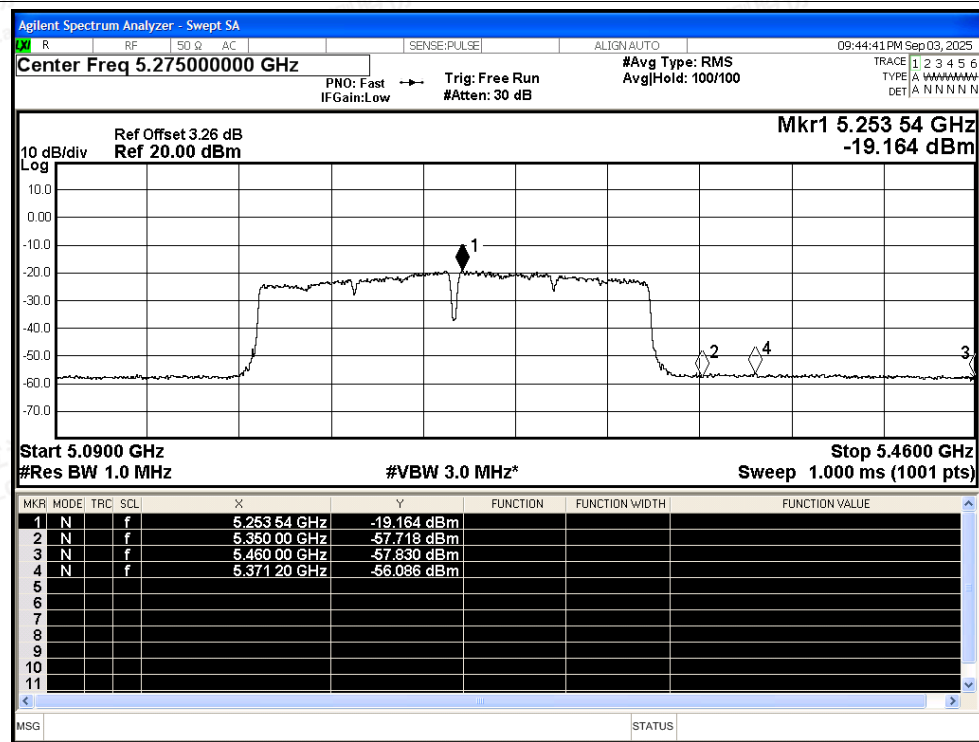




Restrict Band NVNT be160 5250MHz Ant4 Peak

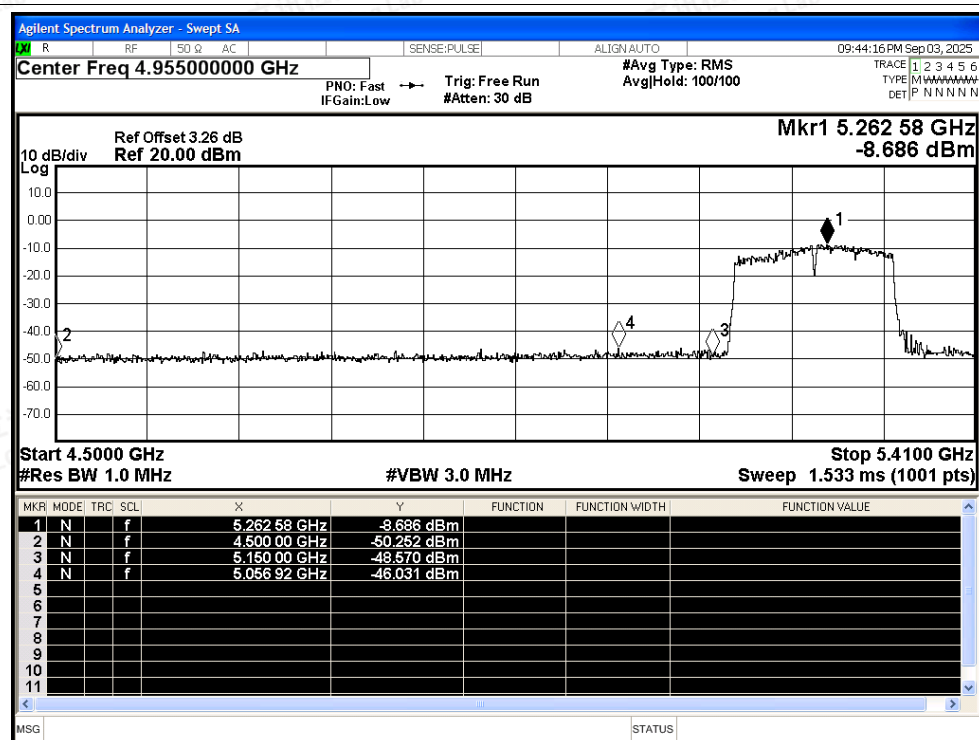

Restrict Band NVNT be160 5250MHz Ant4 Average

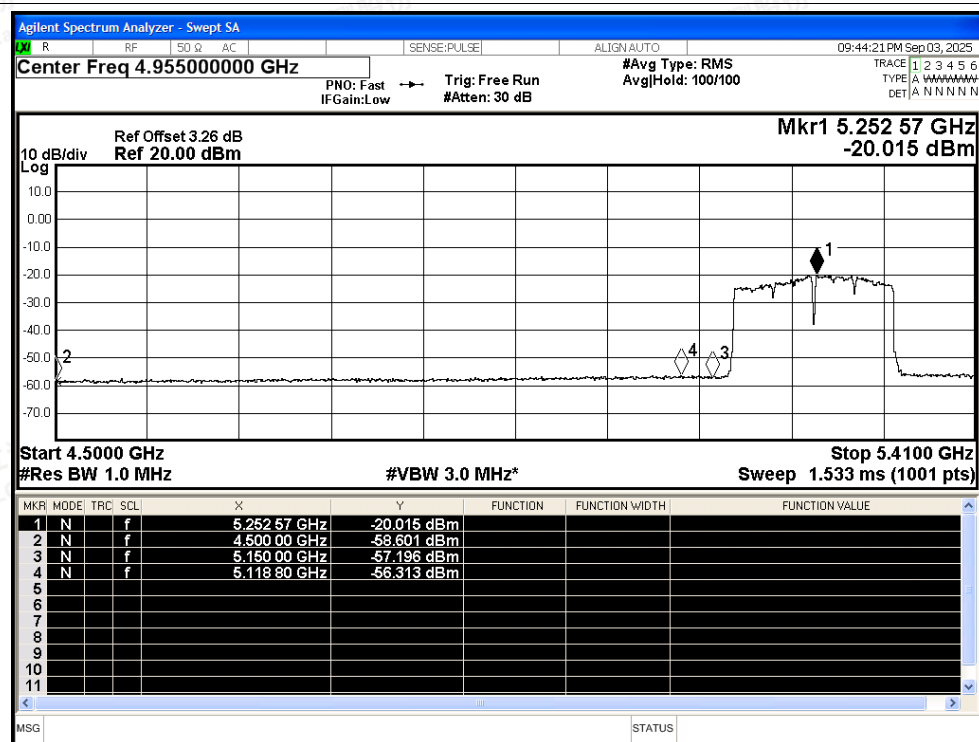

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant5	4500	-51.36	4.28	-	48.15	Peak	68.2	Pass
NVNT	a	5180	Ant5	4500	-58.81	4.28	0.24	40.94	Average	54	Pass
NVNT	a	5180	Ant5	5116	-46.13	4.28	-	53.38	Peak	68.2	Pass
NVNT	a	5180	Ant5	5148.9	-56.34	4.28	0.24	43.41	Average	54	Pass
NVNT	a	5180	Ant5	5150	-46.87	4.28	-	52.64	Peak	68.2	Pass
NVNT	a	5180	Ant5	5150	-56.68	4.28	0.24	43.07	Average	54	Pass
NVNT	a	5240	Ant5	5350	-52.65	4.28	-	46.86	Peak	68.2	Pass
NVNT	a	5240	Ant5	5350	-58.36	4.28	0.24	41.39	Average	54	Pass
NVNT	a	5240	Ant5	5389.92	-47.45	4.28	-	52.06	Peak	68.2	Pass
NVNT	a	5240	Ant5	5385.36	-57.39	4.28	0.24	42.36	Average	54	Pass
NVNT	a	5240	Ant5	5460	-50.29	4.28	-	49.22	Peak	68.2	Pass
NVNT	a	5240	Ant5	5460	-59.18	4.28	0.24	40.57	Average	54	Pass
NVNT	n20	5180	Ant5	4500	-50.46	4.28	-	49.05	Peak	68.2	Pass
NVNT	n20	5180	Ant5	4500	-58.59	4.28	0.12	41.04	Average	54	Pass
NVNT	n20	5180	Ant5	5148.9	-46.22	4.28	-	53.29	Peak	68.2	Pass
NVNT	n20	5180	Ant5	5149.6	-55.62	4.28	0.12	44.01	Average	54	Pass
NVNT	n20	5180	Ant5	5150	-46.12	4.28	-	53.39	Peak	68.2	Pass
NVNT	n20	5180	Ant5	5150	-55.43	4.28	0.12	44.20	Average	54	Pass
NVNT	n20	5240	Ant5	5350	-49.07	4.28	-	50.44	Peak	68.2	Pass
NVNT	n20	5240	Ant5	5350	-58.01	4.28	0.12	41.62	Average	54	Pass
NVNT	n20	5240	Ant5	5381.04	-47.53	4.28	-	51.98	Peak	68.2	Pass
NVNT	n20	5240	Ant5	5445.12	-57.53	4.28	0.12	42.10	Average	54	Pass
NVNT	n20	5240	Ant5	5460	-49.14	4.28	-	50.37	Peak	68.2	Pass
NVNT	n20	5240	Ant5	5460	-58	4.28	0.12	41.63	Average	54	Pass
NVNT	n40	5190	Ant5	4500	-49.54	4.28	-	49.97	Peak	68.2	Pass
NVNT	n40	5190	Ant5	4500	-58.76	4.28	0.24	40.99	Average	54	Pass
NVNT	n40	5190	Ant5	5149.7	-43.89	4.28	-	55.62	Peak	68.2	Pass
NVNT	n40	5190	Ant5	5148.97	-55.55	4.28	0.24	44.20	Average	54	Pass
NVNT	n40	5190	Ant5	5150	-43.89	4.28	-	55.62	Peak	68.2	Pass
NVNT	n40	5190	Ant5	5150	-55.67	4.28	0.24	44.08	Average	54	Pass
NVNT	n40	5230	Ant5	5350	-51.11	4.28	-	48.40	Peak	68.2	Pass
NVNT	n40	5230	Ant5	5350	-58.06	4.28	0.24	41.69	Average	54	Pass
NVNT	n40	5230	Ant5	5397.9	-47.46	4.28	-	52.05	Peak	68.2	Pass
NVNT	n40	5230	Ant5	5350.92	-57.37	4.28	0.24	42.38	Average	54	Pass
NVNT	n40	5230	Ant5	5460	-49.93	4.28	-	49.58	Peak	68.2	Pass
NVNT	n40	5230	Ant5	5460	-58.01	4.28	0.24	41.74	Average	54	Pass
NVNT	ac20	5180	Ant5	4500	-47.85	4.28	-	51.66	Peak	68.2	Pass





NVNT	ac20	5180	Ant5	4500	-58.79	4.28	0.12	40.84	Average	54	Pass
NVNT	ac20	5180	Ant5	5146.1	-40.5	4.28	-	59.01	Peak	68.2	Pass
NVNT	ac20	5180	Ant5	5146.8	-55.95	4.28	0.12	43.68	Average	54	Pass
NVNT	ac20	5180	Ant5	5150	-44.29	4.28	-	55.22	Peak	68.2	Pass
NVNT	ac20	5180	Ant5	5150	-55.07	4.28	0.12	44.56	Average	54	Pass
NVNT	ac20	5240	Ant5	5350	-48.79	4.28	-	50.72	Peak	68.2	Pass
NVNT	ac20	5240	Ant5	5350	-58.05	4.28	0.12	41.58	Average	54	Pass
NVNT	ac20	5240	Ant5	5431.2	-47.53	4.28	-	51.98	Peak	68.2	Pass
NVNT	ac20	5240	Ant5	5377.68	-57.53	4.28	0.12	42.10	Average	54	Pass
NVNT	ac20	5240	Ant5	5460	-48.95	4.28	-	50.56	Peak	68.2	Pass
NVNT	ac20	5240	Ant5	5460	-58.53	4.28	0.12	41.10	Average	54	Pass
NVNT	ac40	5190	Ant5	4500	-51.54	4.28	-	47.97	Peak	68.2	Pass
NVNT	ac40	5190	Ant5	4500	-58.32	4.28	0.24	41.43	Average	54	Pass
NVNT	ac40	5190	Ant5	5148.97	-45.4	4.28	-	54.11	Peak	68.2	Pass
NVNT	ac40	5190	Ant5	5149.7	-55.43	4.28	0.24	44.32	Average	54	Pass
NVNT	ac40	5190	Ant5	5150	-47.37	4.28	-	52.14	Peak	68.2	Pass
NVNT	ac40	5190	Ant5	5150	-55.43	4.28	0.24	44.32	Average	54	Pass
NVNT	ac40	5230	Ant5	5350	-48.3	4.28	-	51.21	Peak	68.2	Pass
NVNT	ac40	5230	Ant5	5350	-58.47	4.28	0.23	41.27	Average	54	Pass
NVNT	ac40	5230	Ant5	5428.14	-47.51	4.28	-	52.00	Peak	68.2	Pass
NVNT	ac40	5230	Ant5	5357.94	-57.21	4.28	0.23	42.53	Average	54	Pass
NVNT	ac40	5230	Ant5	5460	-51.47	4.28	-	48.04	Peak	68.2	Pass
NVNT	ac40	5230	Ant5	5460	-58.32	4.28	0.23	41.42	Average	54	Pass
NVNT	ac80	5210	Ant5	5350	-49.31	4.28	-	50.20	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	5350	-56.92	4.28	0.47	43.06	Average	54	Pass
NVNT	ac80	5210	Ant5	5382.45	-46.7	4.28	-	52.81	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	5352.09	-55.79	4.28	0.47	44.19	Average	54	Pass
NVNT	ac80	5210	Ant5	5460	-49.16	4.28	-	50.35	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	5460	-58.13	4.28	0.47	41.85	Average	54	Pass
NVNT	ac80	5210	Ant5	4500	-49.05	4.28	-	50.46	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	4500	-58.47	4.28	0.47	41.51	Average	54	Pass
NVNT	ac80	5210	Ant5	5145.43	-45.01	4.28	-	54.50	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	5148.59	-55.46	4.28	0.47	44.52	Average	54	Pass
NVNT	ac80	5210	Ant5	5150	-48.9	4.28	-	50.61	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	5150	-55.04	4.28	0.47	44.94	Average	54	Pass
NVNT	ax20	5180	Ant5	4500	-50.53	4.28	-	48.98	Peak	68.2	Pass
NVNT	ax20	5180	Ant5	4500	-58.82	4.28	0.12	40.81	Average	54	Pass
NVNT	ax20	5180	Ant5	5036.2	-45.61	4.28	-	53.90	Peak	68.2	Pass
NVNT	ax20	5180	Ant5	5149.6	-55.94	4.28	0.12	43.69	Average	54	Pass
NVNT	ax20	5180	Ant5	5150	-43.54	4.28	-	55.97	Peak	68.2	Pass
NVNT	ax20	5180	Ant5	5150	-56.22	4.28	0.12	43.41	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant5	5350	-50.05	4.28	-	49.46	Peak	68.2	Pass
NVNT	ax20	5240	Ant5	5350	-58.66	4.28	0.12	40.97	Average	54	Pass
NVNT	ax20	5240	Ant5	5364	-47.62	4.28	-	51.89	Peak	68.2	Pass
NVNT	ax20	5240	Ant5	5442	-57.46	4.28	0.12	42.17	Average	54	Pass
NVNT	ax20	5240	Ant5	5460	-49.93	4.28	-	49.58	Peak	68.2	Pass
NVNT	ax20	5240	Ant5	5460	-58.57	4.28	0.12	41.06	Average	54	Pass
NVNT	ax40	5190	Ant5	4500	-50.23	4.28	-	49.28	Peak	68.2	Pass
NVNT	ax40	5190	Ant5	4500	-58.67	4.28	0.23	41.07	Average	54	Pass
NVNT	ax40	5190	Ant5	5149.7	-42.93	4.28	-	56.58	Peak	68.2	Pass
NVNT	ax40	5190	Ant5	5149.7	-55.37	4.28	0.23	44.37	Average	54	Pass
NVNT	ax40	5190	Ant5	5150	-42.93	4.28	-	56.58	Peak	68.2	Pass
NVNT	ax40	5190	Ant5	5150	-55.37	4.28	0.23	44.37	Average	54	Pass
NVNT	ax40	5230	Ant5	5350	-50.11	4.28	-	49.40	Peak	68.2	Pass
NVNT	ax40	5230	Ant5	5350	-57.75	4.28	0.24	42.00	Average	54	Pass
NVNT	ax40	5230	Ant5	5372.79	-47.23	4.28	-	52.28	Peak	68.2	Pass
NVNT	ax40	5230	Ant5	5421.66	-57.27	4.28	0.24	42.48	Average	54	Pass
NVNT	ax40	5230	Ant5	5460	-48.9	4.28	-	50.61	Peak	68.2	Pass
NVNT	ax40	5230	Ant5	5460	-58.51	4.28	0.24	41.24	Average	54	Pass
NVNT	ax80	5210	Ant5	5350	-47.67	4.28	-	51.84	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	5350	-56.38	4.28	0.47	43.60	Average	54	Pass
NVNT	ax80	5210	Ant5	5356.38	-46.39	4.28	-	53.12	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	5351.43	-55.85	4.28	0.47	44.13	Average	54	Pass
NVNT	ax80	5210	Ant5	5460	-49.42	4.28	-	50.09	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	5460	-57.82	4.28	0.47	42.16	Average	54	Pass
NVNT	ax80	5210	Ant5	4500	-51.97	4.28	-	47.54	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	4500	-58.99	4.28	0.47	40.99	Average	54	Pass
NVNT	ax80	5210	Ant5	5146.22	-44.77	4.28	-	54.74	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	5147.01	-55.75	4.28	0.47	44.23	Average	54	Pass
NVNT	ax80	5210	Ant5	5150	-46.58	4.28	-	52.93	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	5150	-55.52	4.28	0.47	44.46	Average	54	Pass
NVNT	be20	5180	Ant5	4500	-50.8	4.28	-	48.71	Peak	68.2	Pass
NVNT	be20	5180	Ant5	4500	-58.5	4.28	0.12	41.13	Average	54	Pass
NVNT	be20	5180	Ant5	5130	-46.42	4.28	-	53.09	Peak	68.2	Pass
NVNT	be20	5180	Ant5	5149.6	-55.98	4.28	0.12	43.65	Average	54	Pass
NVNT	be20	5180	Ant5	5150	-45.71	4.28	-	53.80	Peak	68.2	Pass
NVNT	be20	5180	Ant5	5150	-55.92	4.28	0.12	43.71	Average	54	Pass
NVNT	be20	5240	Ant5	5350	-47.9	4.28	-	51.61	Peak	68.2	Pass
NVNT	be20	5240	Ant5	5350	-57.79	4.28	0.12	41.84	Average	54	Pass
NVNT	be20	5240	Ant5	5411.76	-47.07	4.28	-	52.44	Peak	68.2	Pass
NVNT	be20	5240	Ant5	5430.24	-57.53	4.28	0.12	42.10	Average	54	Pass
NVNT	be20	5240	Ant5	5460	-47.93	4.28	-	51.58	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be20	5240	Ant5	5460	-58.27	4.28	0.12	41.36	Average	54	Pass
NVNT	be40	5190	Ant5	4500	-50.01	4.28	-	49.50	Peak	68.2	Pass
NVNT	be40	5190	Ant5	4500	-59.19	4.28	0.24	40.56	Average	54	Pass
NVNT	be40	5190	Ant5	5148.24	-45.13	4.28	-	54.38	Peak	68.2	Pass
NVNT	be40	5190	Ant5	5149.7	-54.63	4.28	0.24	45.12	Average	54	Pass
NVNT	be40	5190	Ant5	5150	-45.97	4.28	-	53.54	Peak	68.2	Pass
NVNT	be40	5190	Ant5	5150	-54.63	4.28	0.24	45.12	Average	54	Pass
NVNT	be40	5230	Ant5	5350	-50.68	4.28	-	48.83	Peak	68.2	Pass
NVNT	be40	5230	Ant5	5350	-58	4.28	0.24	41.75	Average	54	Pass
NVNT	be40	5230	Ant5	5364.42	-46.86	4.28	-	52.65	Peak	68.2	Pass
NVNT	be40	5230	Ant5	5412.75	-57.38	4.28	0.24	42.37	Average	54	Pass
NVNT	be40	5230	Ant5	5460	-50.4	4.28	-	49.11	Peak	68.2	Pass
NVNT	be40	5230	Ant5	5460	-58.36	4.28	0.24	41.39	Average	54	Pass
NVNT	be80	5210	Ant5	5350	-48.13	4.28	-	51.38	Peak	68.2	Pass
NVNT	be80	5210	Ant5	5350	-56.36	4.28	0.47	43.62	Average	54	Pass
NVNT	be80	5210	Ant5	5353.74	-45.33	4.28	-	54.18	Peak	68.2	Pass
NVNT	be80	5210	Ant5	5362.98	-55.82	4.28	0.47	44.16	Average	54	Pass
NVNT	be80	5210	Ant5	5460	-49.11	4.28	-	50.40	Peak	68.2	Pass
NVNT	be80	5210	Ant5	5460	-58.65	4.28	0.47	41.33	Average	54	Pass
NVNT	be80	5210	Ant5	4500	-50.02	4.28	-	49.49	Peak	68.2	Pass
NVNT	be80	5210	Ant5	4500	-58.8	4.28	0.47	41.18	Average	54	Pass
NVNT	be80	5210	Ant5	5148.59	-45.35	4.28	-	54.16	Peak	68.2	Pass
NVNT	be80	5210	Ant5	5149.38	-55.31	4.28	0.47	44.67	Average	54	Pass
NVNT	be80	5210	Ant5	5150	-45.21	4.28	-	54.30	Peak	68.2	Pass
NVNT	be80	5210	Ant5	5150	-54.88	4.28	0.47	45.10	Average	54	Pass
NVNT	ac160	5250	Ant5	5350	-43.29	4.28	-	56.22	Peak	68.2	Pass
NVNT	ac160	5250	Ant5	5350	-64.39	4.28	3.76	38.88	Average	54	Pass
NVNT	ac160	5250	Ant5	5350.11	-43.29	4.28	-	56.22	Peak	68.2	Pass
NVNT	ac160	5250	Ant5	5401.91	-61.45	4.28	3.76	41.82	Average	54	Pass
NVNT	ac160	5250	Ant5	5460	-59.27	4.28	-	40.24	Peak	68.2	Pass
NVNT	ac160	5250	Ant5	5460	-67.42	4.28	3.76	35.85	Average	54	Pass
NVNT	ac160	5250	Ant5	4500	-60.2	4.28	-	39.31	Peak	68.2	Pass
NVNT	ac160	5250	Ant5	4500	-68.18	4.28	3.76	35.09	Average	54	Pass
NVNT	ac160	5250	Ant5	5119.71	-51.51	4.28	-	48.00	Peak	68.2	Pass
NVNT	ac160	5250	Ant5	5145.19	-63.72	4.28	3.76	39.55	Average	54	Pass
NVNT	ac160	5250	Ant5	5150	-54.08	4.28	-	45.43	Peak	68.2	Pass
NVNT	ac160	5250	Ant5	5150	-64.1	4.28	3.76	39.17	Average	54	Pass
NVNT	ax160	5250	Ant5	5350	-44.1	4.28	-	55.41	Peak	68.2	Pass
NVNT	ax160	5250	Ant5	5350	-64.56	4.28	3.77	38.72	Average	54	Pass
NVNT	ax160	5250	Ant5	5350.11	-44.1	4.28	-	55.41	Peak	68.2	Pass
NVNT	ax160	5250	Ant5	5359.36	-61.46	4.28	3.77	41.82	Average	54	Pass






NVNT	ax160	5250	Ant5	5460	-58.67	4.28	-	40.84	Peak	68.2	Pass
NVNT	ax160	5250	Ant5	5460	-67.7	4.28	3.77	35.58	Average	54	Pass
NVNT	ax160	5250	Ant5	4500	-60.69	4.28	-	38.82	Peak	68.2	Pass
NVNT	ax160	5250	Ant5	4500	-68.59	4.28	3.77	34.69	Average	54	Pass
NVNT	ax160	5250	Ant5	5122.44	-50.37	4.28	-	49.14	Peak	68.2	Pass
NVNT	ax160	5250	Ant5	5138.82	-63.28	4.28	3.77	40.00	Average	54	Pass
NVNT	ax160	5250	Ant5	5150	-50.89	4.28	-	48.62	Peak	68.2	Pass
NVNT	ax160	5250	Ant5	5150	-63.58	4.28	3.77	39.70	Average	54	Pass
NVNT	be160	5250	Ant5	5350	-44.76	4.28	-	54.75	Peak	68.2	Pass
NVNT	be160	5250	Ant5	5350	-57.74	4.28	3.79	45.56	Average	54	Pass
NVNT	be160	5250	Ant5	5364.17	-43.03	4.28	-	56.48	Peak	68.2	Pass
NVNT	be160	5250	Ant5	5408.2	-56.61	4.28	3.79	46.69	Average	54	Pass
NVNT	be160	5250	Ant5	5460	-48.67	4.28	-	50.84	Peak	68.2	Pass
NVNT	be160	5250	Ant5	5460	-57.65	4.28	3.79	45.65	Average	54	Pass
NVNT	be160	5250	Ant5	4500	-50.79	4.28	-	48.72	Peak	68.2	Pass
NVNT	be160	5250	Ant5	4500	-58.57	4.28	3.79	44.73	Average	54	Pass
NVNT	be160	5250	Ant5	5147.01	-46.1	4.28	-	53.41	Peak	68.2	Pass
NVNT	be160	5250	Ant5	5123.35	-56.47	4.28	3.79	46.83	Average	54	Pass
NVNT	be160	5250	Ant5	5150	-48.27	4.28	-	51.24	Peak	68.2	Pass
NVNT	be160	5250	Ant5	5150	-57.53	4.28	3.79	45.77	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant5 Peak

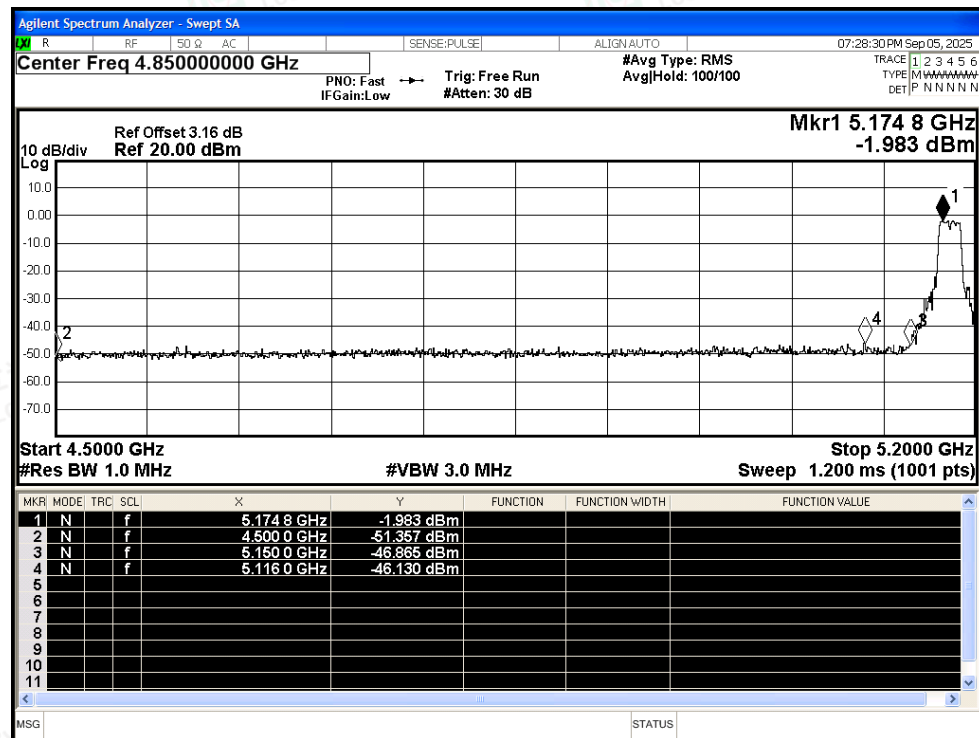

Restrict Band NVNT a 5180MHz Ant5 Average

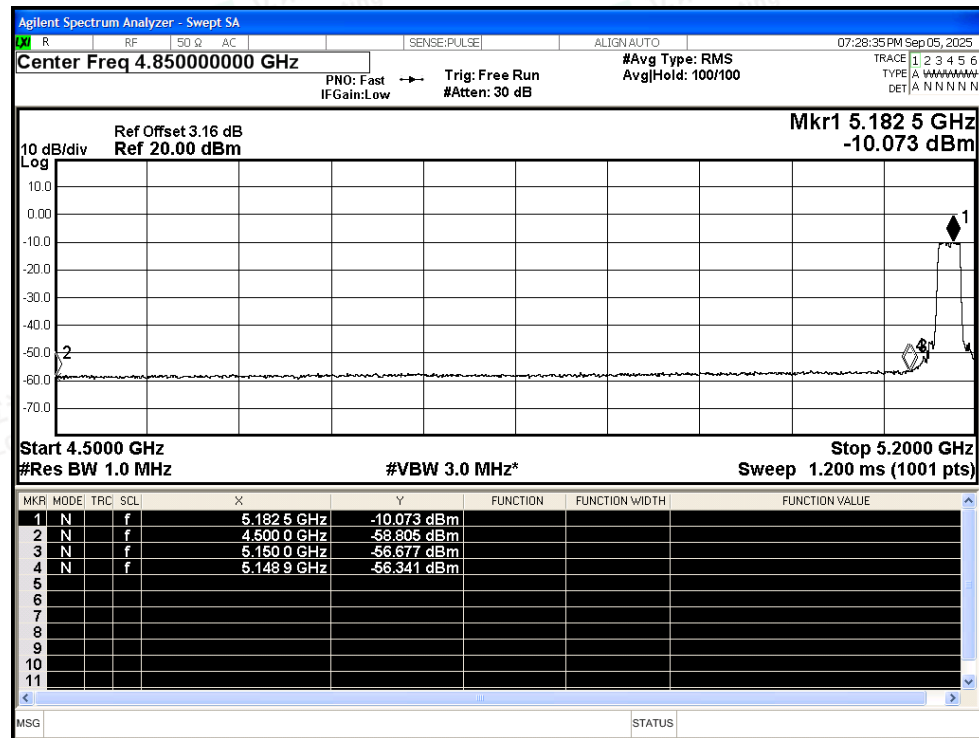

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant5 Peak

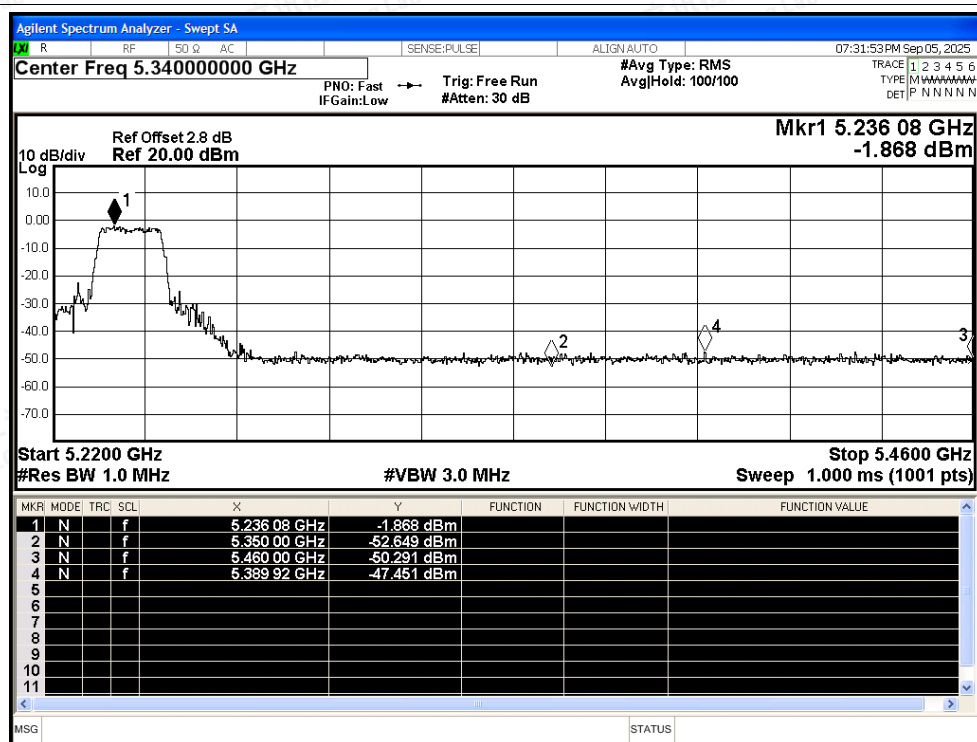

Restrict Band NVNT a 5240MHz Ant5 Average

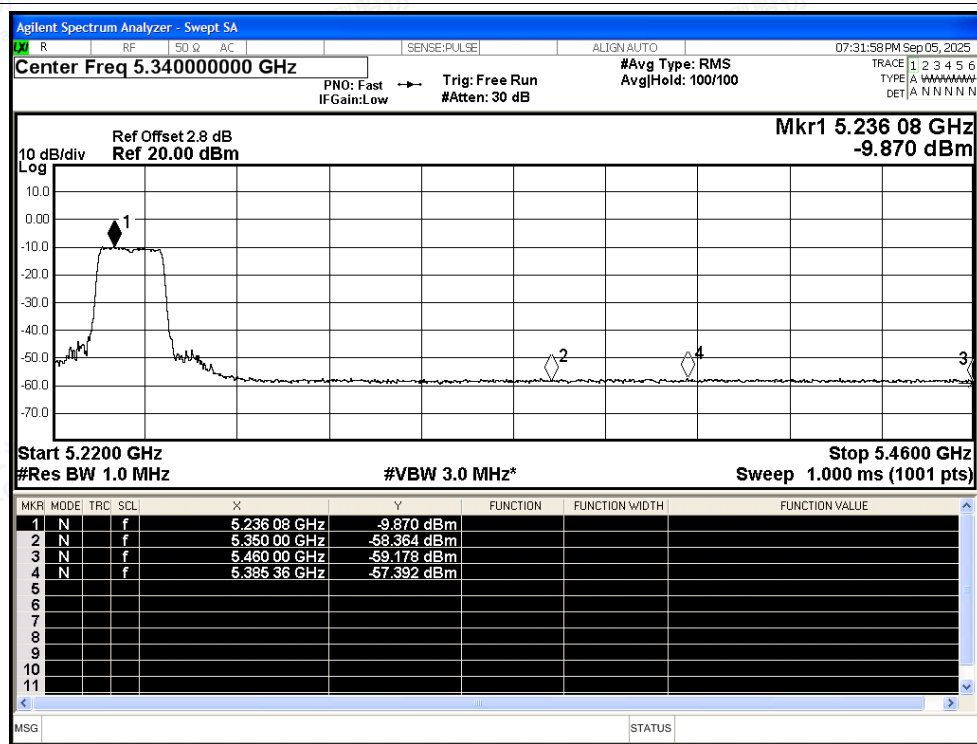

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant5 Peak

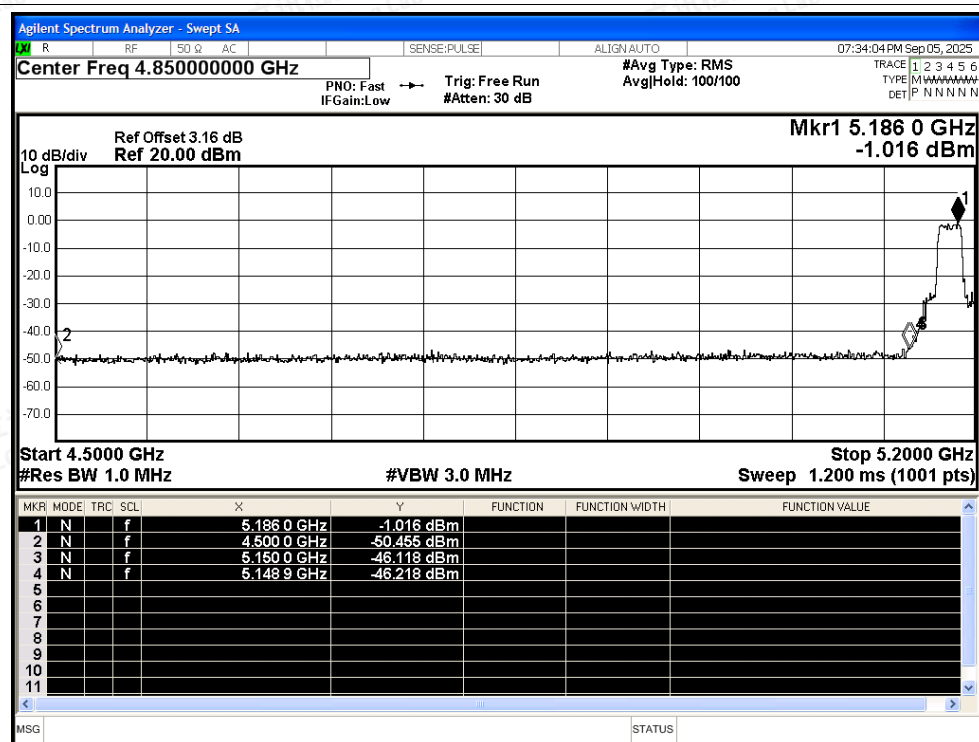


Restrict Band NVNT n20 5180MHz Ant5 Average

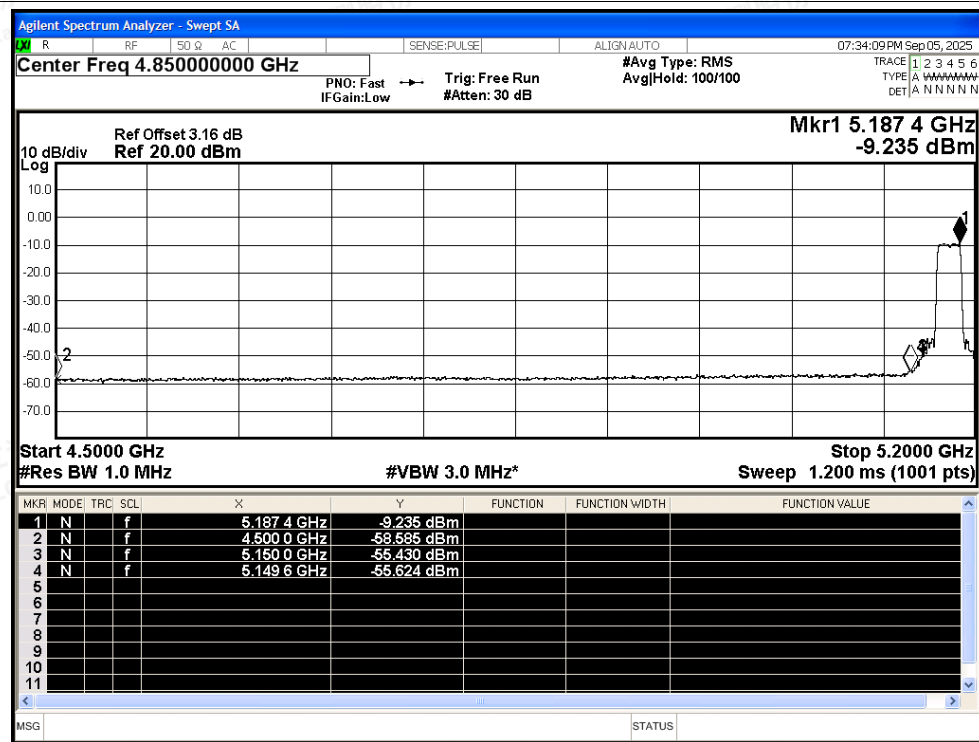




Restrict Band NVNT n20 5240MHz Ant5 Peak

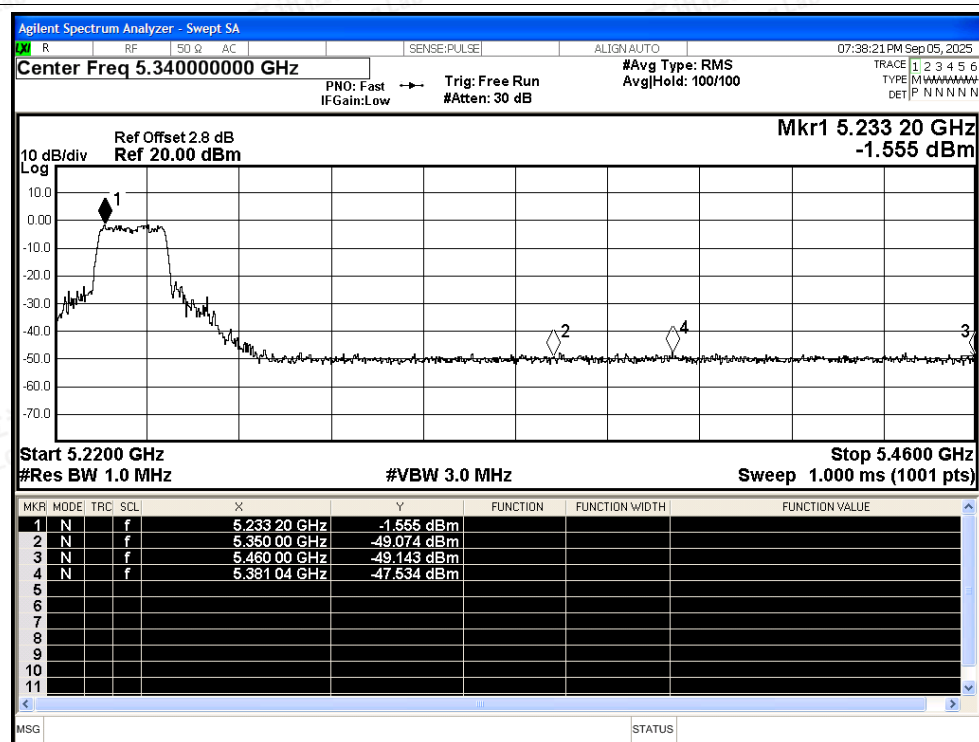

Restrict Band NVNT n20 5240MHz Ant5 Average

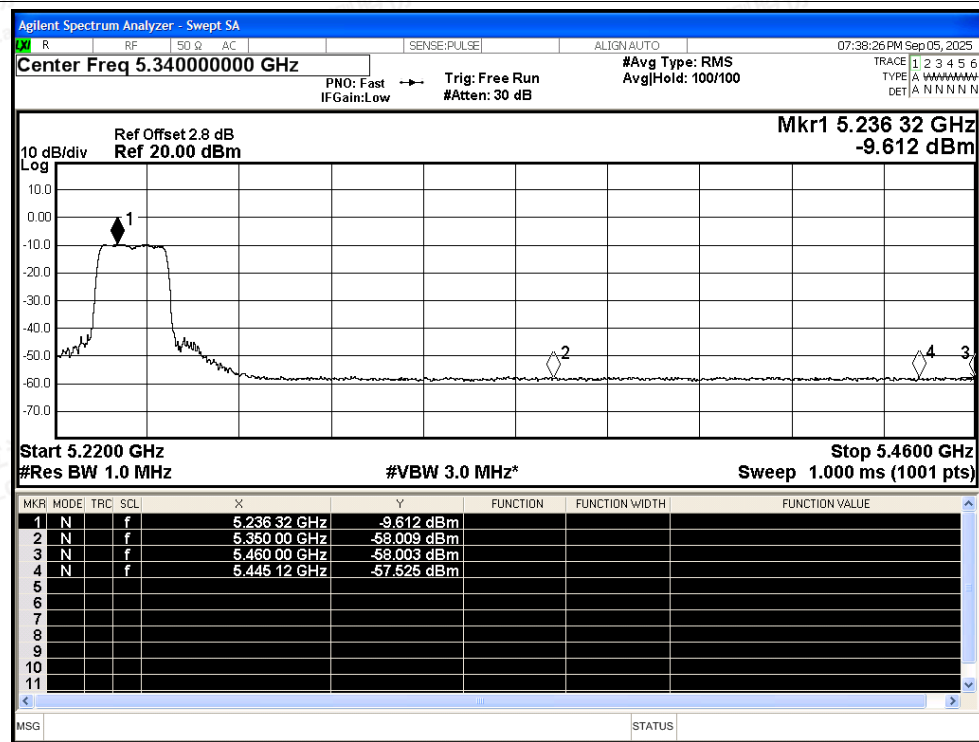

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant5 Peak

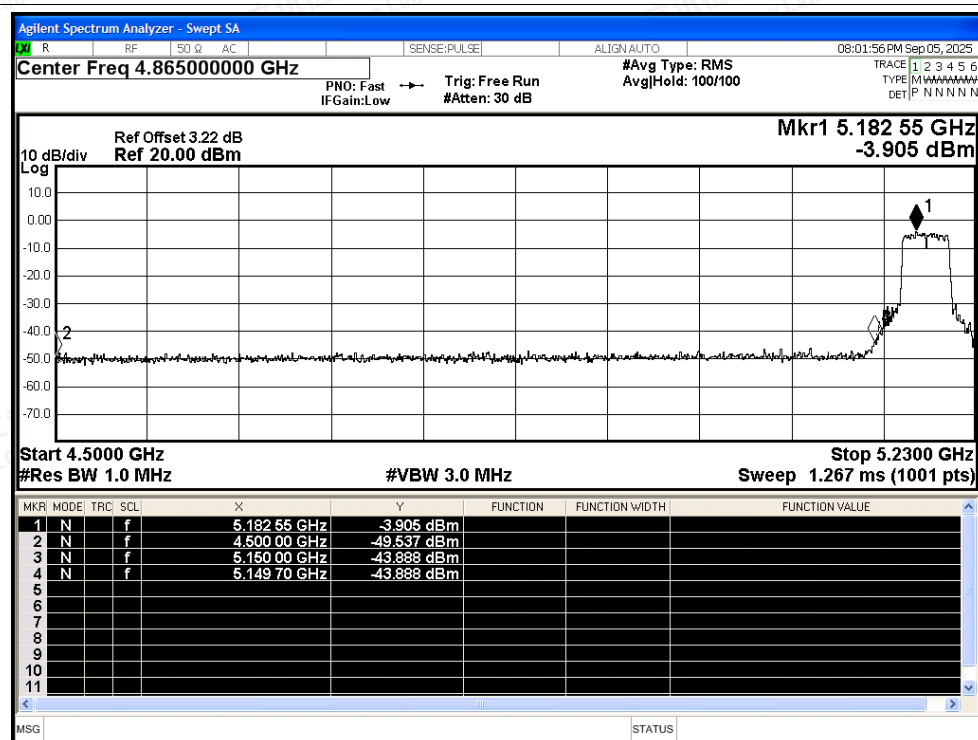

Restrict Band NVNT n40 5190MHz Ant5 Average

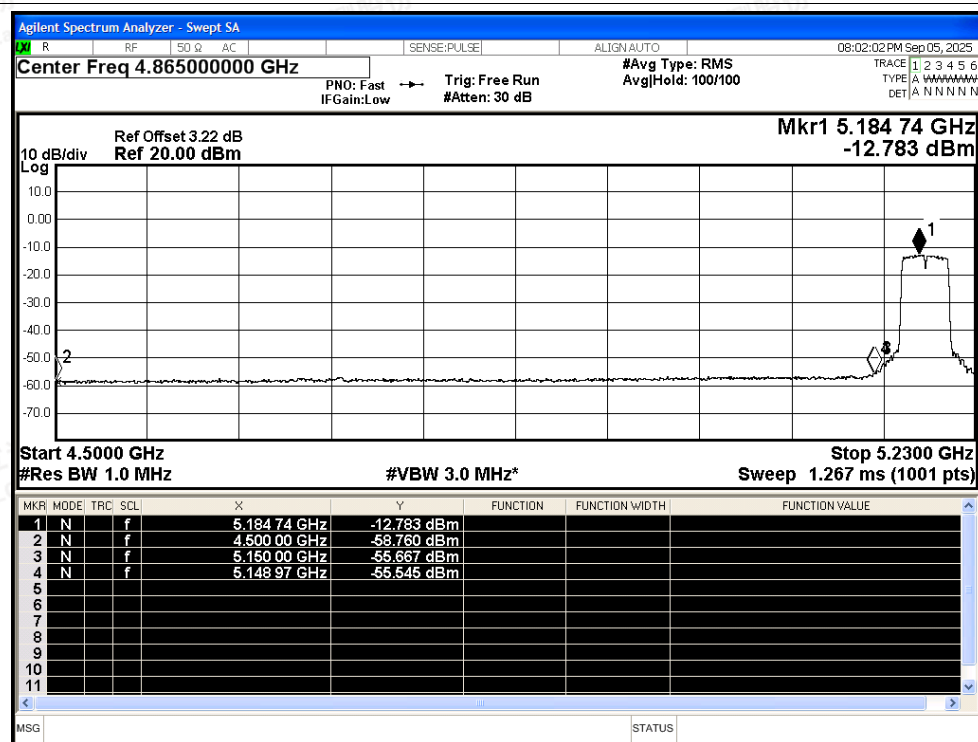

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant5 Peak

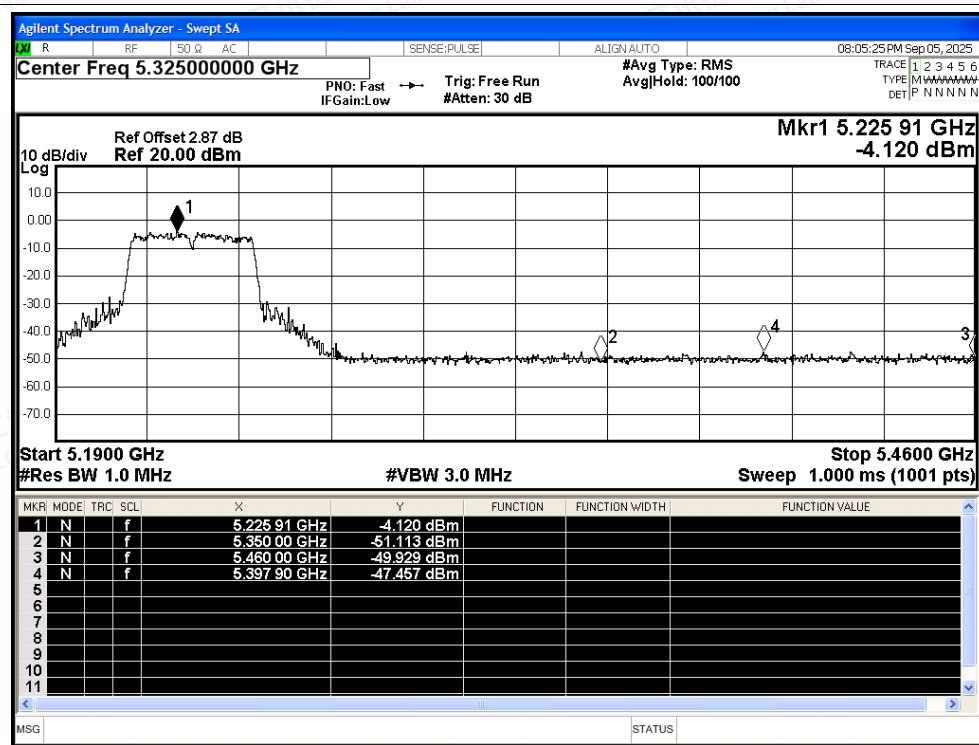

Restrict Band NVNT n40 5230MHz Ant5 Average

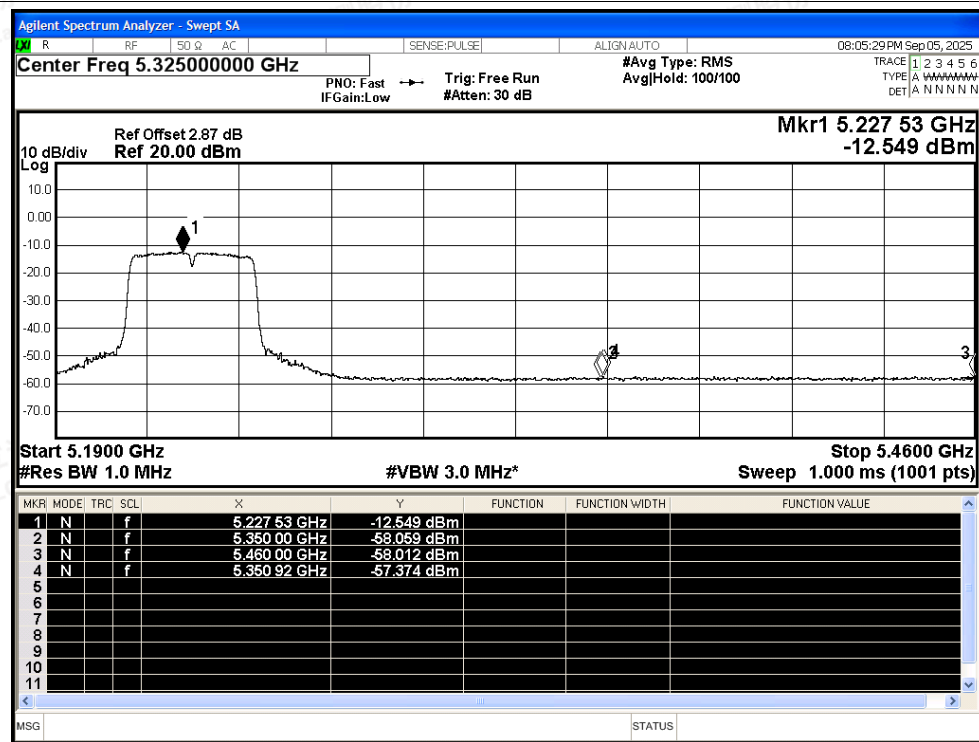

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant5 Peak

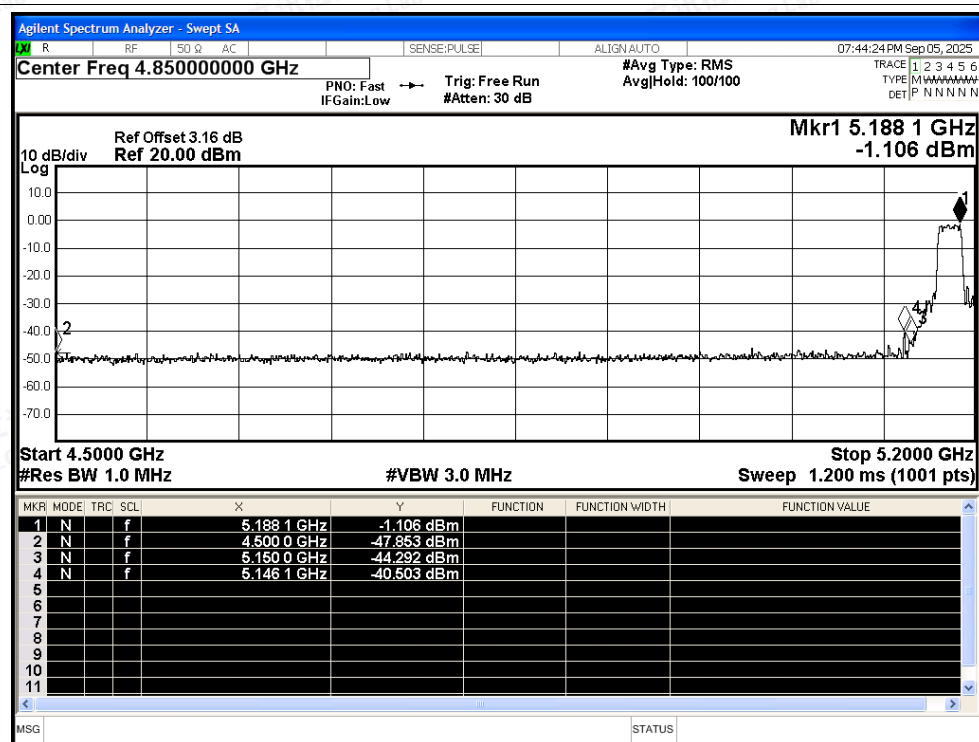


Restrict Band NVNT ac20 5180MHz Ant5 Average

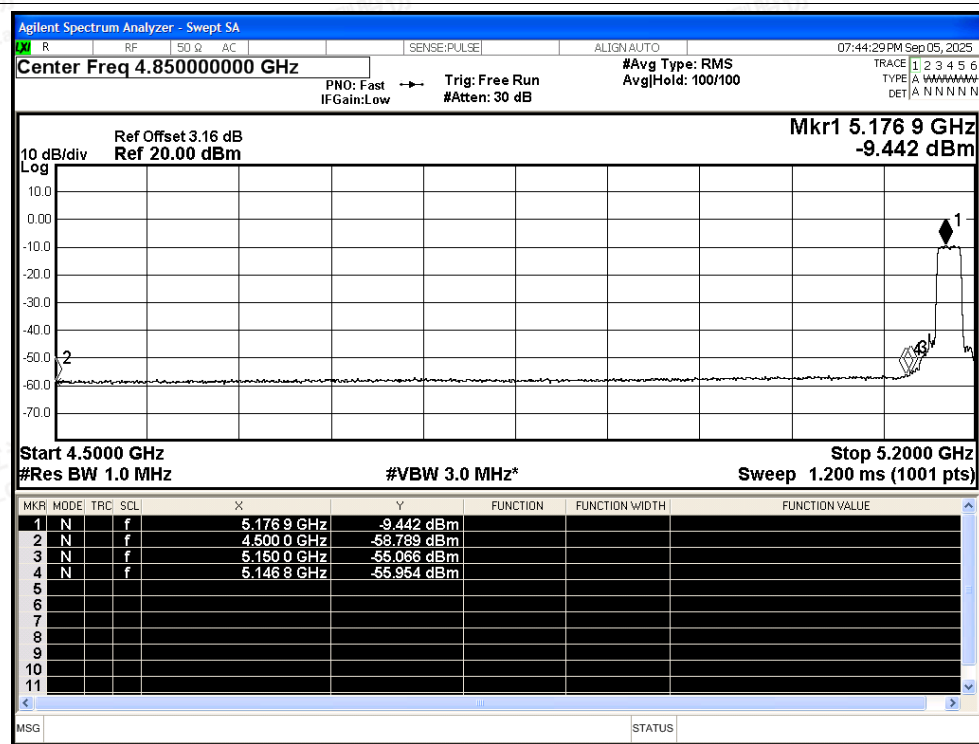




Restrict Band NVNT ac20 5240MHz Ant5 Peak

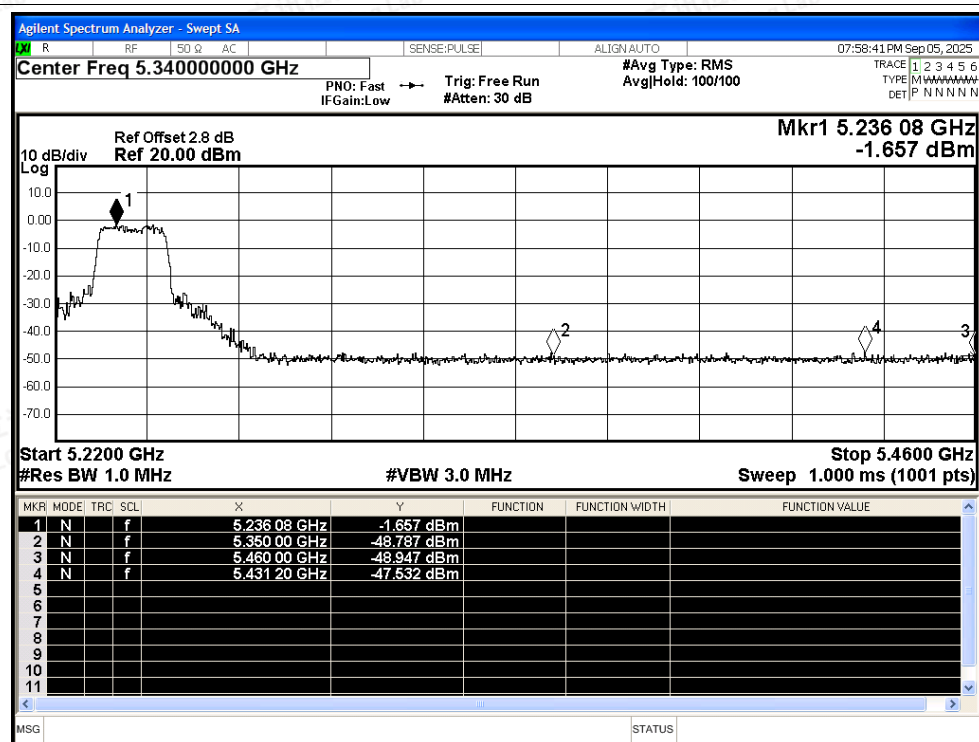

Restrict Band NVNT ac20 5240MHz Ant5 Average

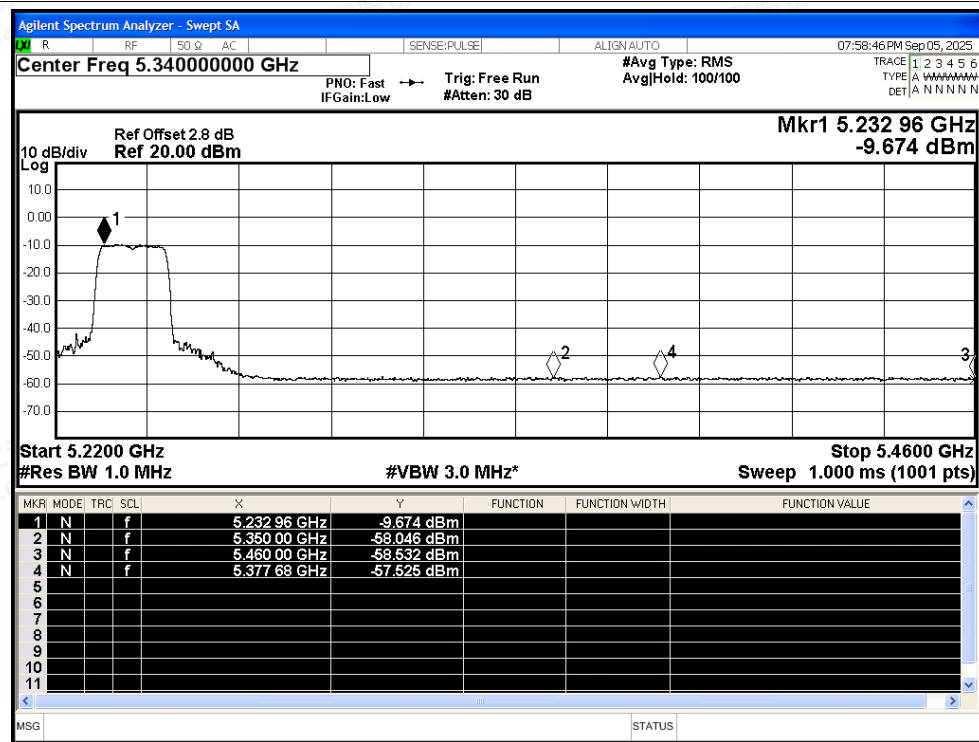

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant5 Peak

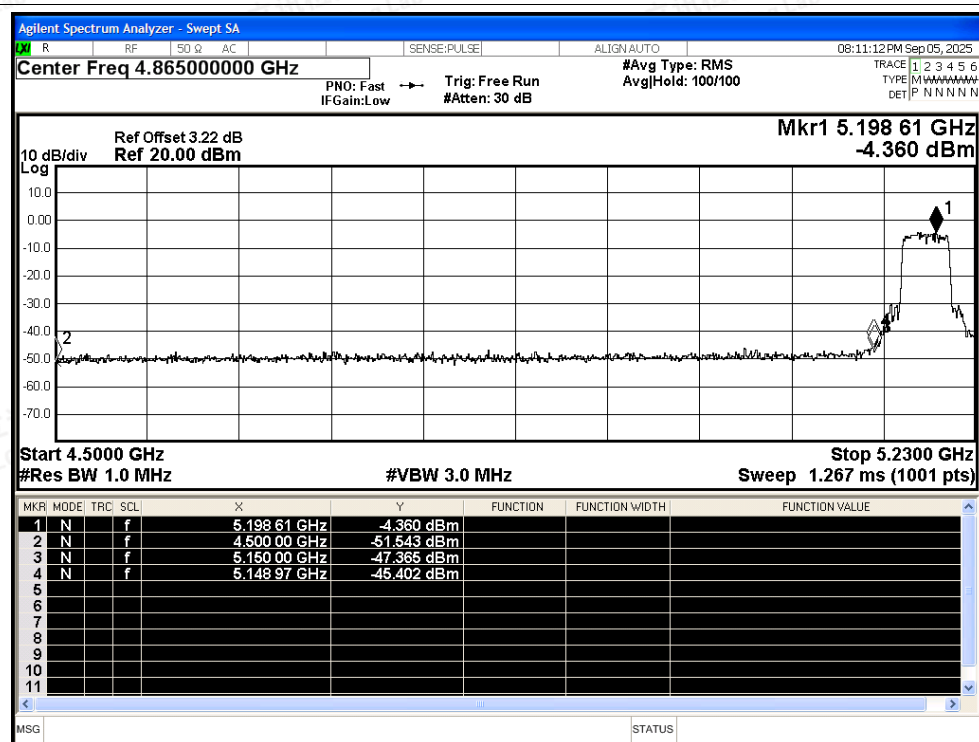


Restrict Band NVNT ac40 5190MHz Ant5 Average

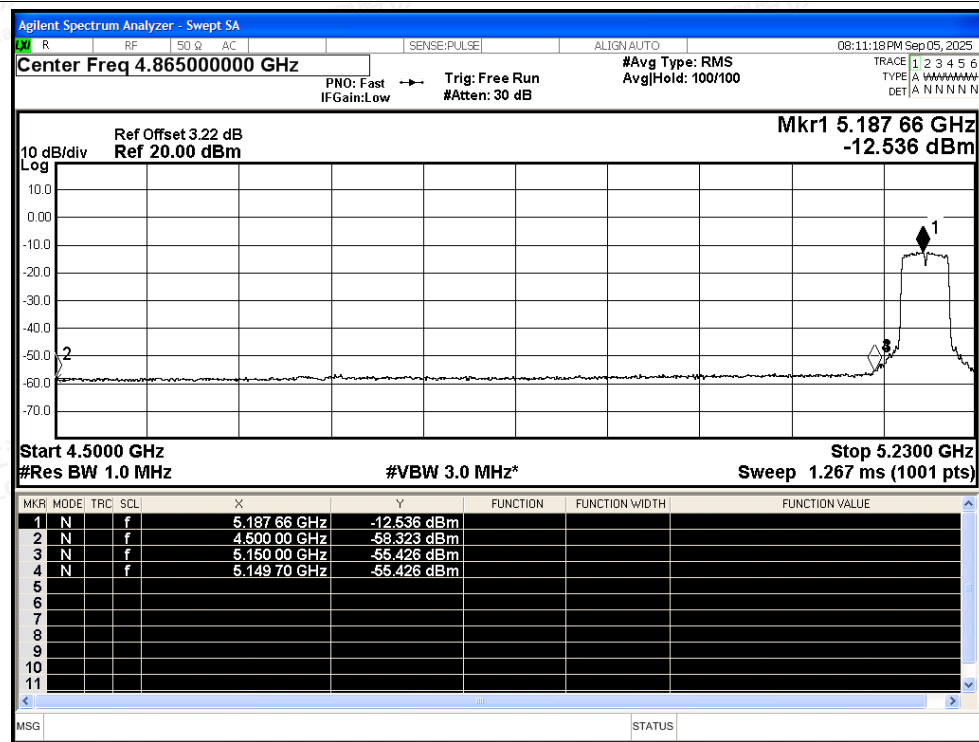




Restrict Band NVNT ac40 5230MHz Ant5 Peak

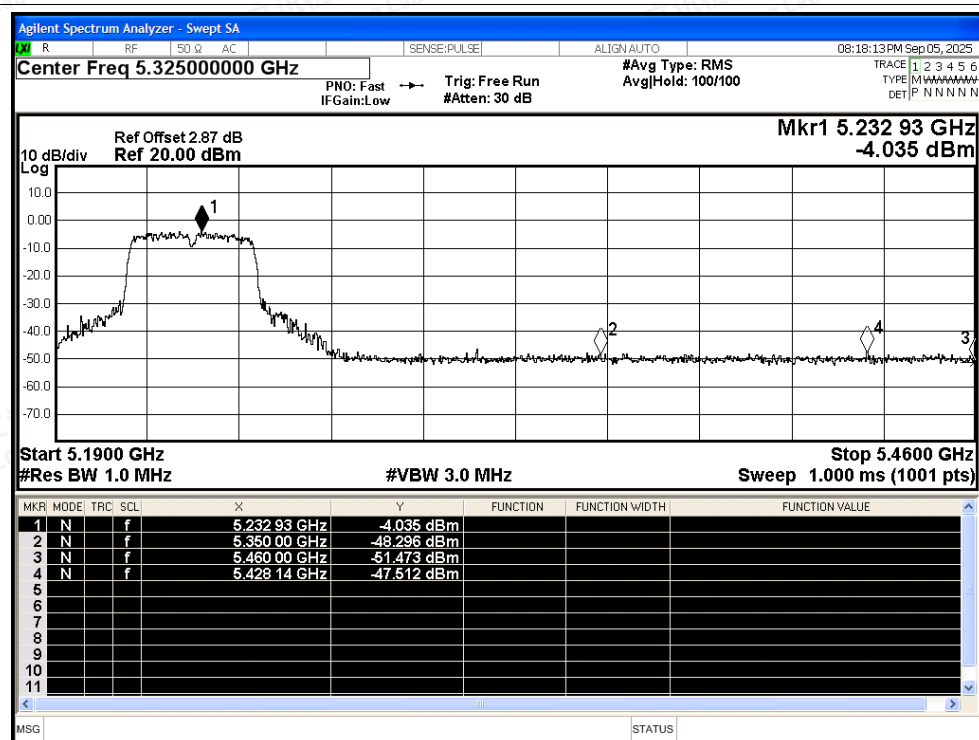

Restrict Band NVNT ac40 5230MHz Ant5 Average

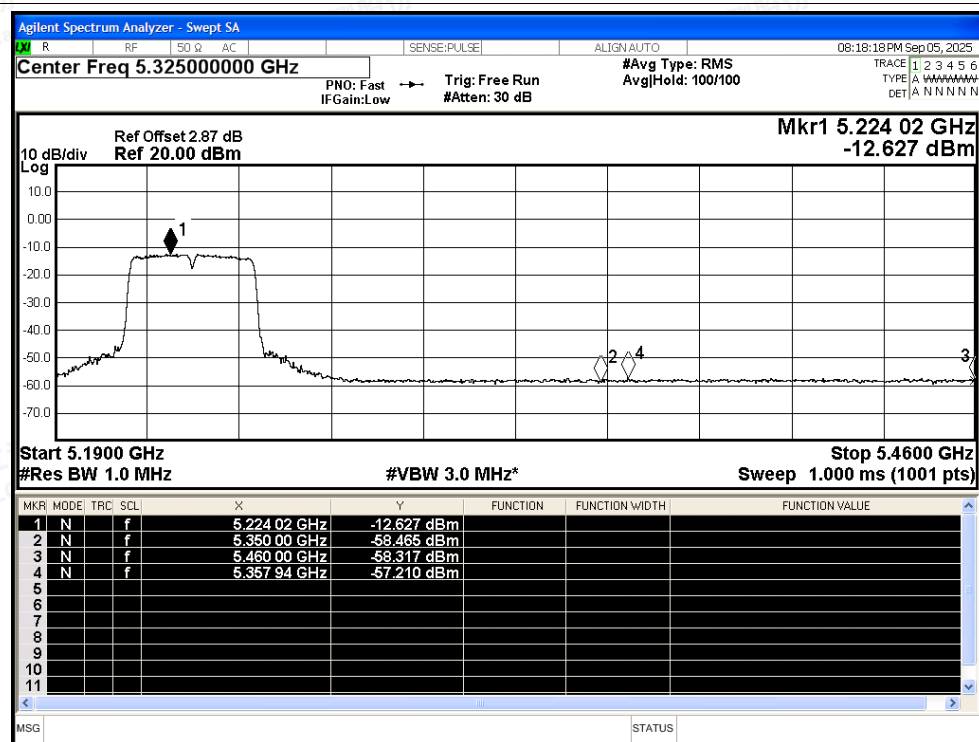

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant5 Peak

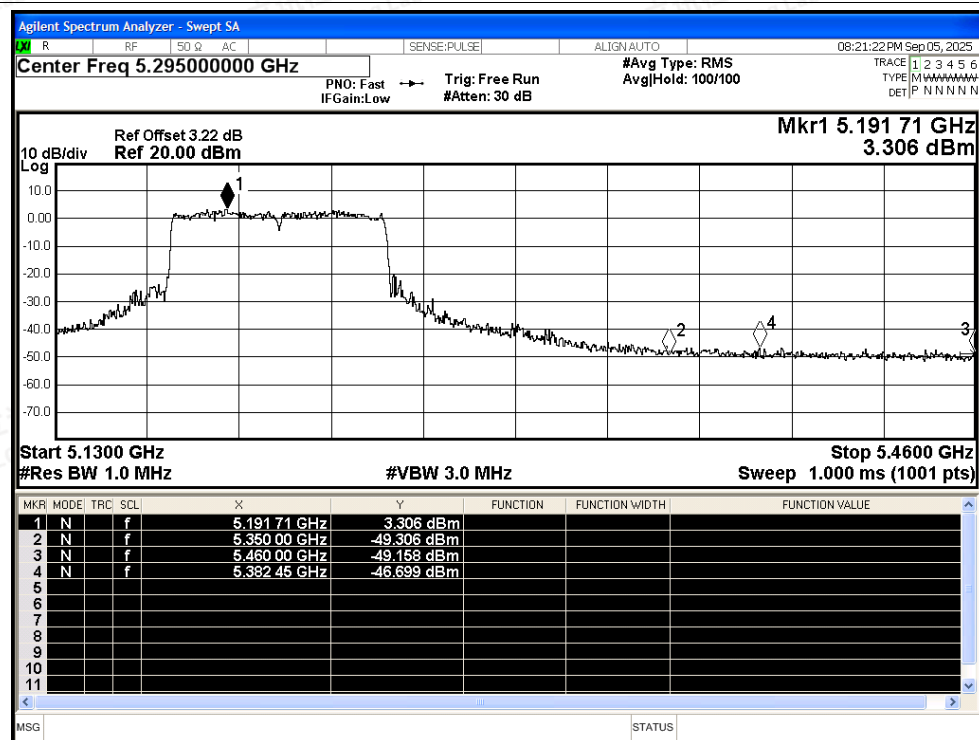

Restrict Band NVNT ac80 5210MHz Ant5 Average

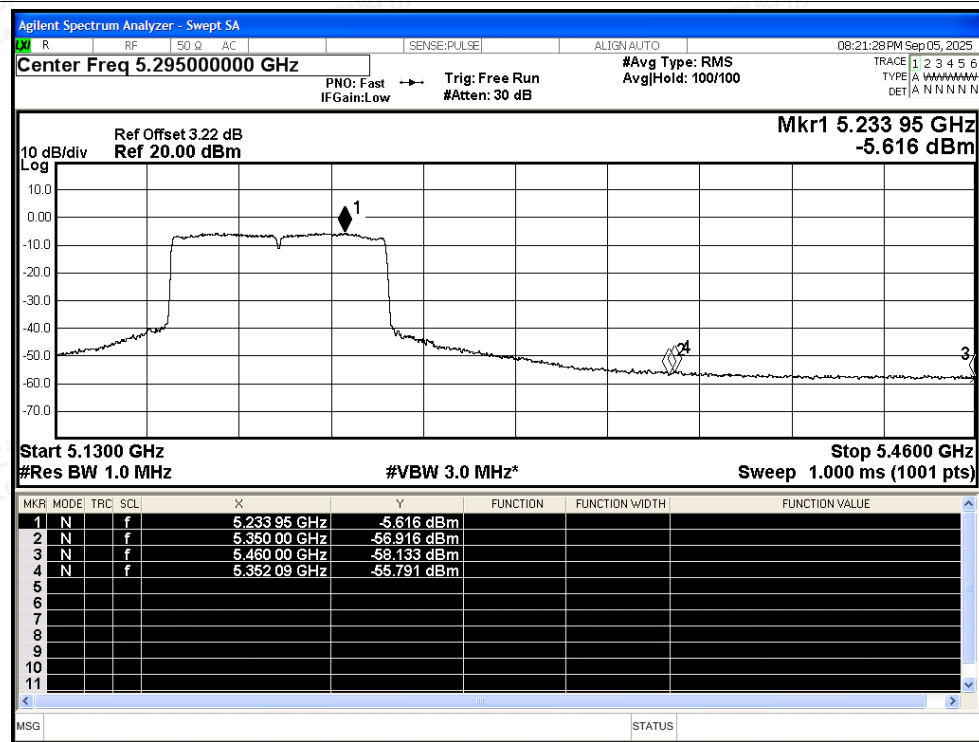

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant5 Peak

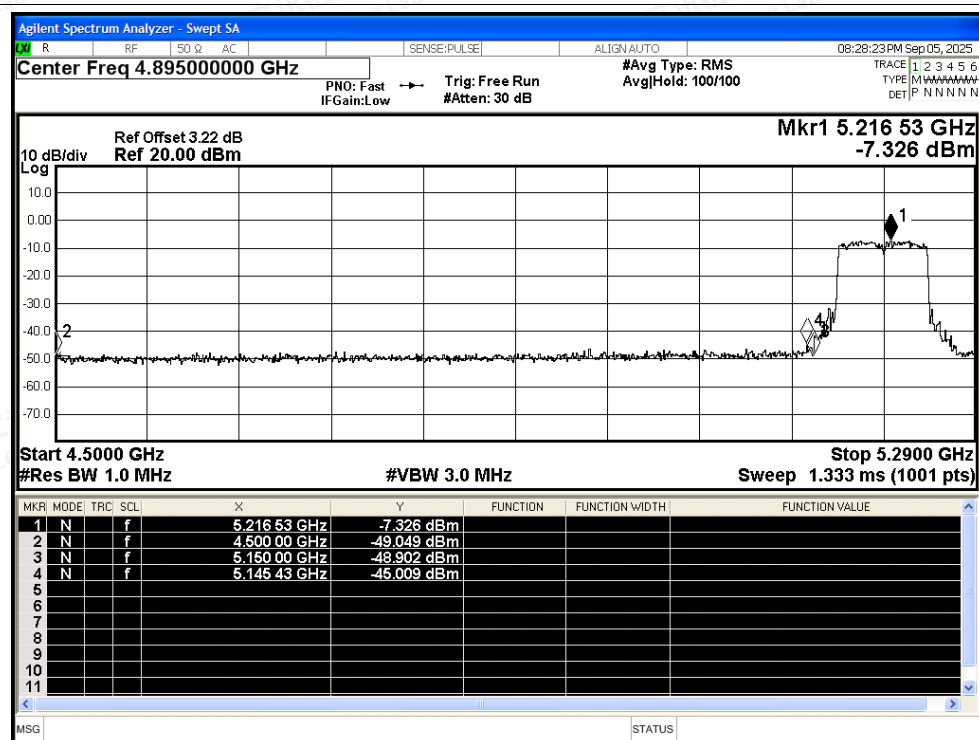

Restrict Band NVNT ac80 5210MHz Ant5 Average

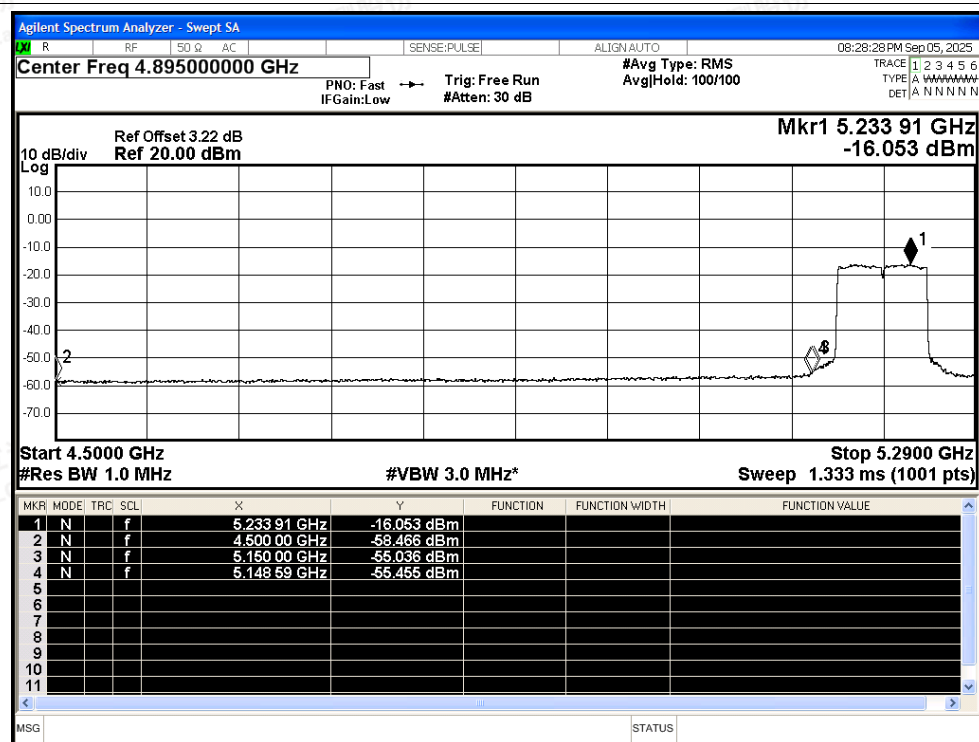

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant5 Peak

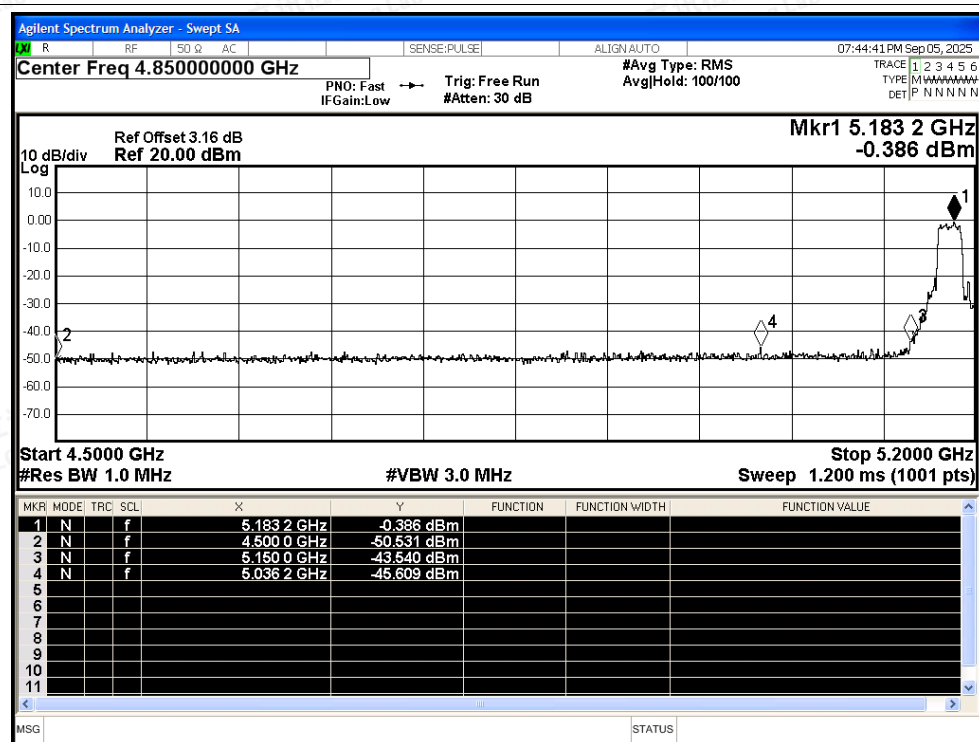

Restrict Band NVNT ax20 5180MHz Ant5 Average

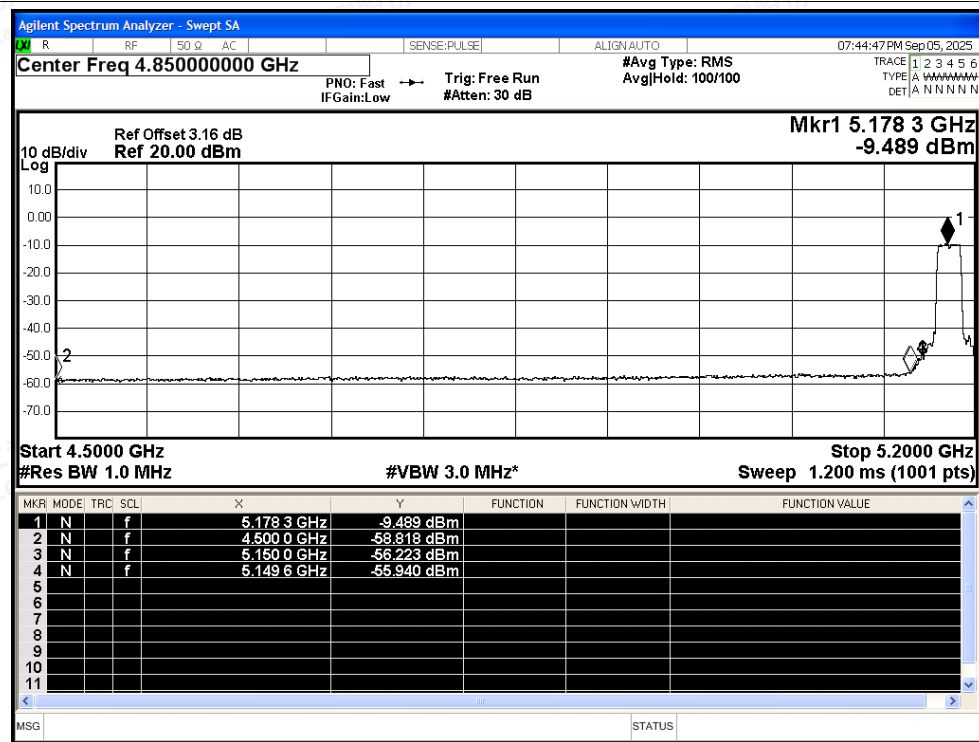

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant5 Peak

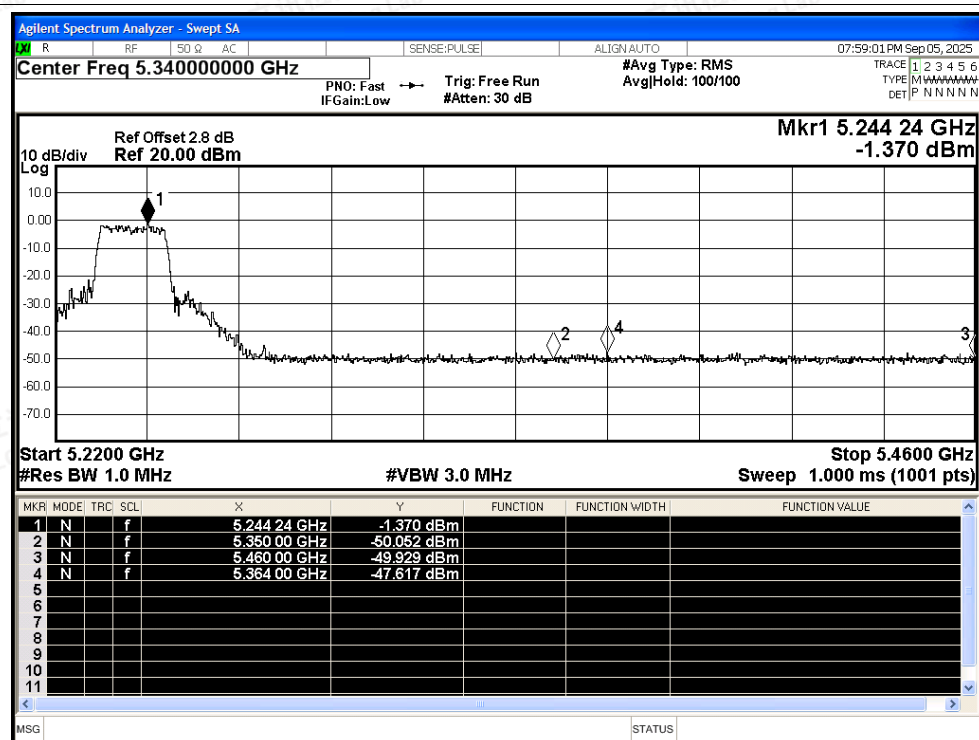

Restrict Band NVNT ax20 5240MHz Ant5 Average

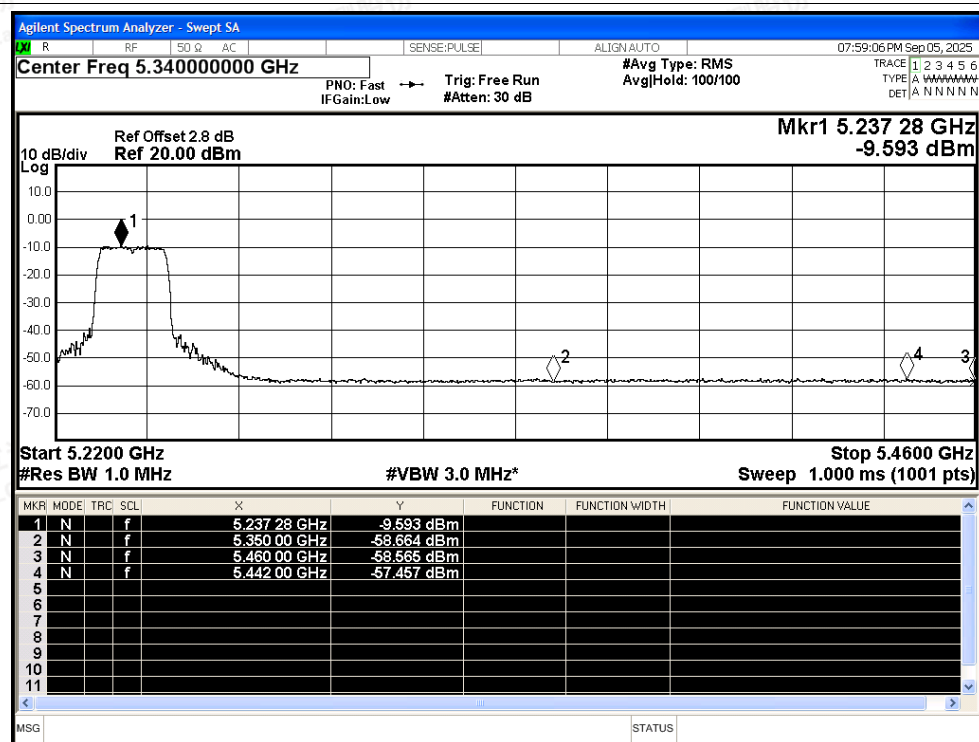

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant5 Peak

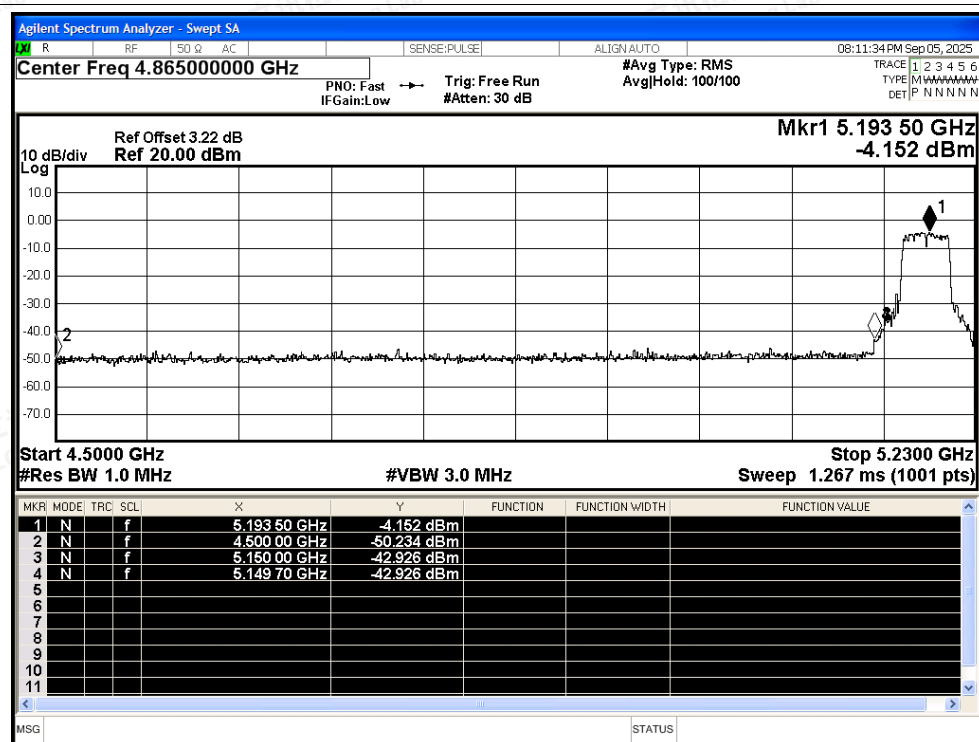


Restrict Band NVNT ax40 5190MHz Ant5 Average

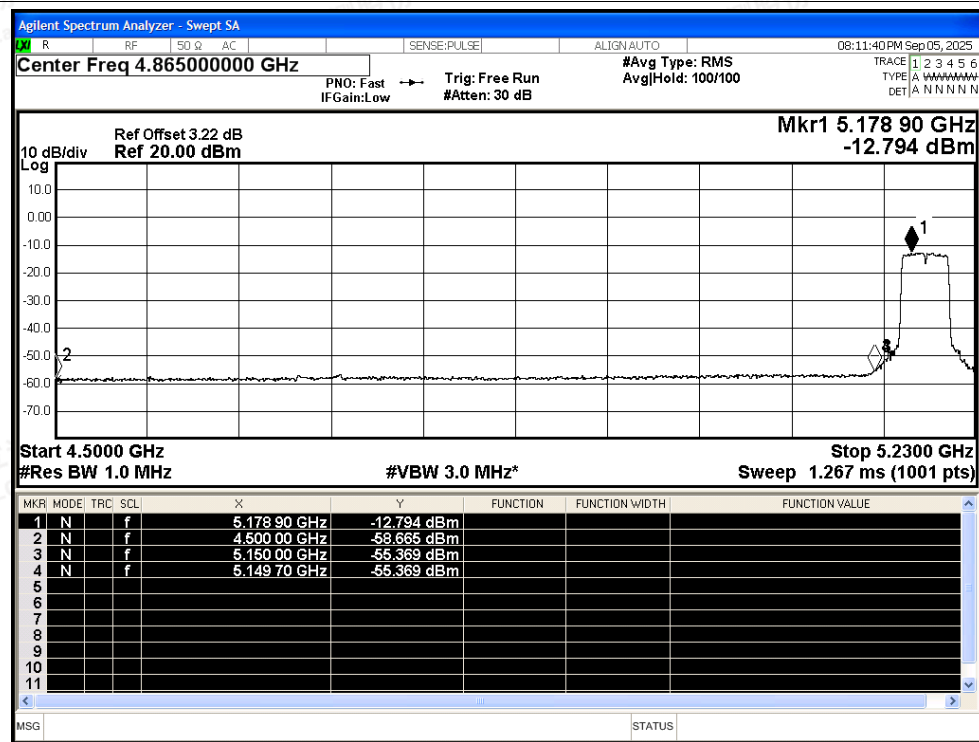




Restrict Band NVNT ax40 5230MHz Ant5 Peak

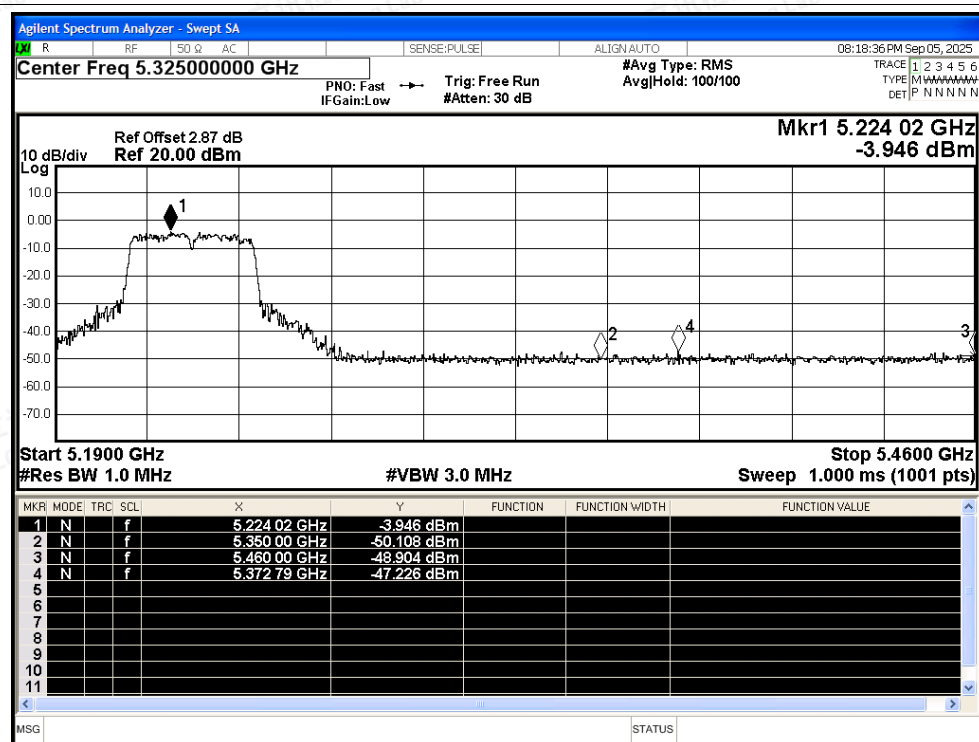

Restrict Band NVNT ax40 5230MHz Ant5 Average

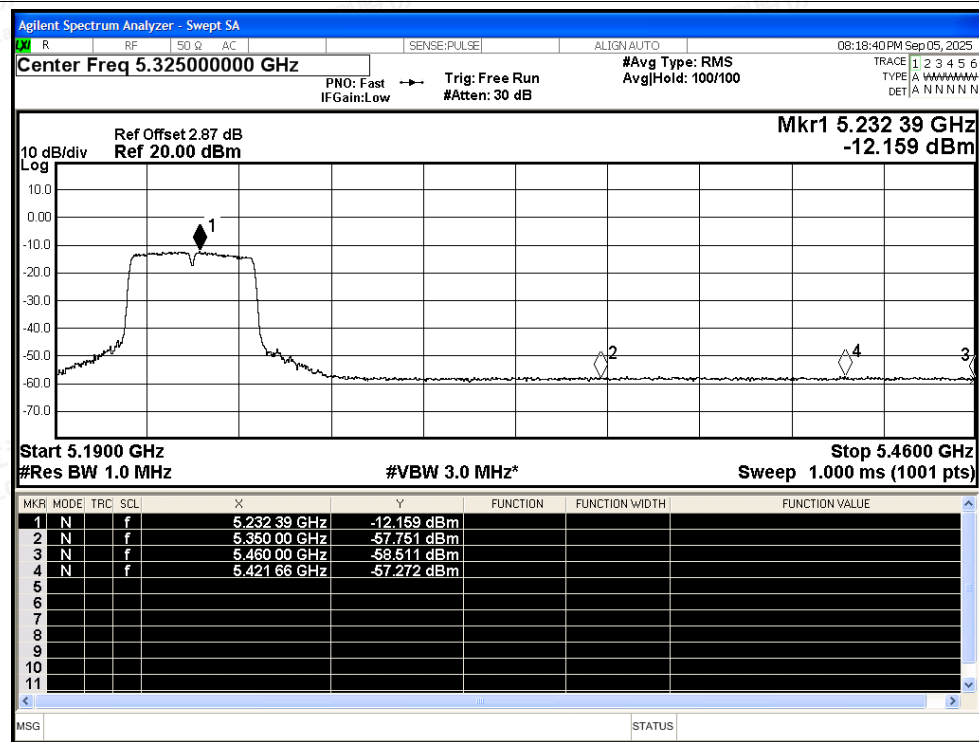

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant5 Peak

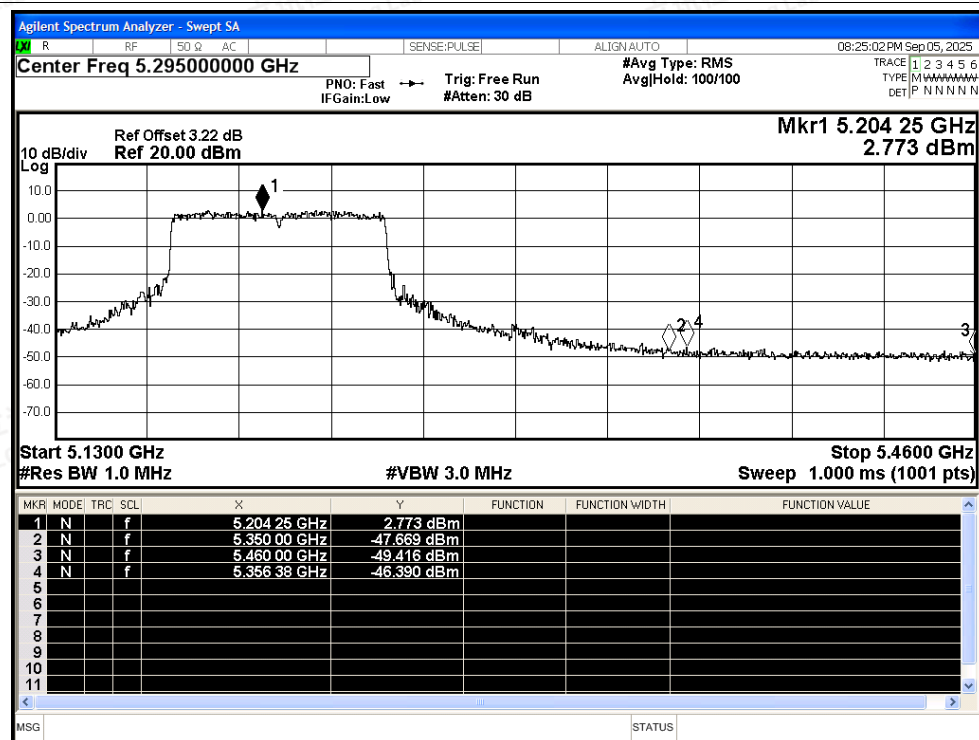

Restrict Band NVNT ax80 5210MHz Ant5 Average

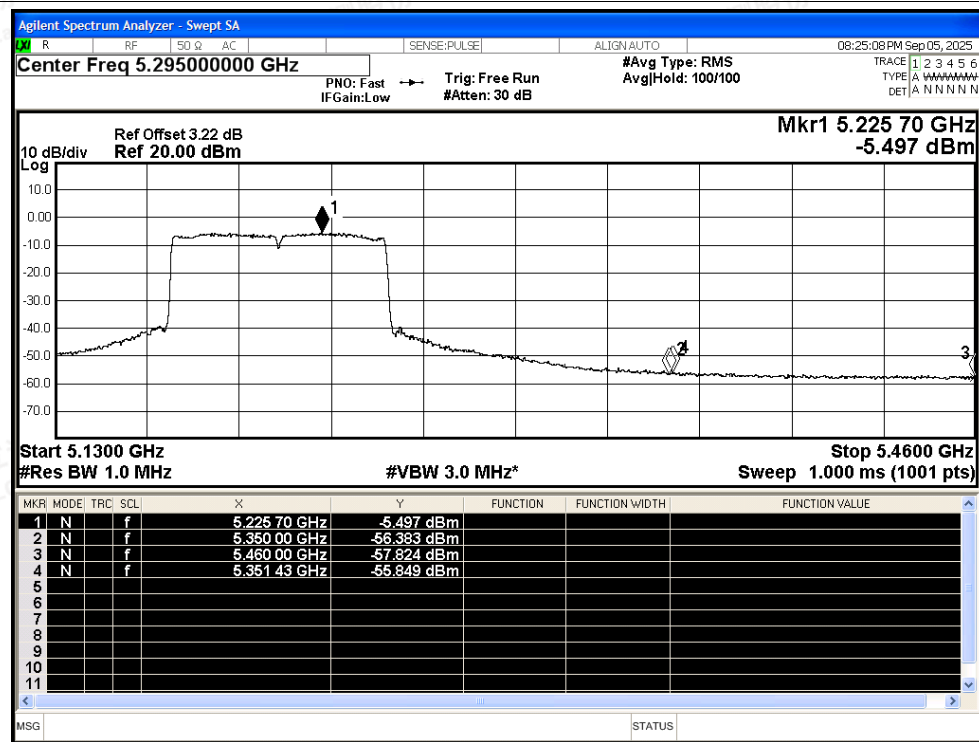

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant5 Peak

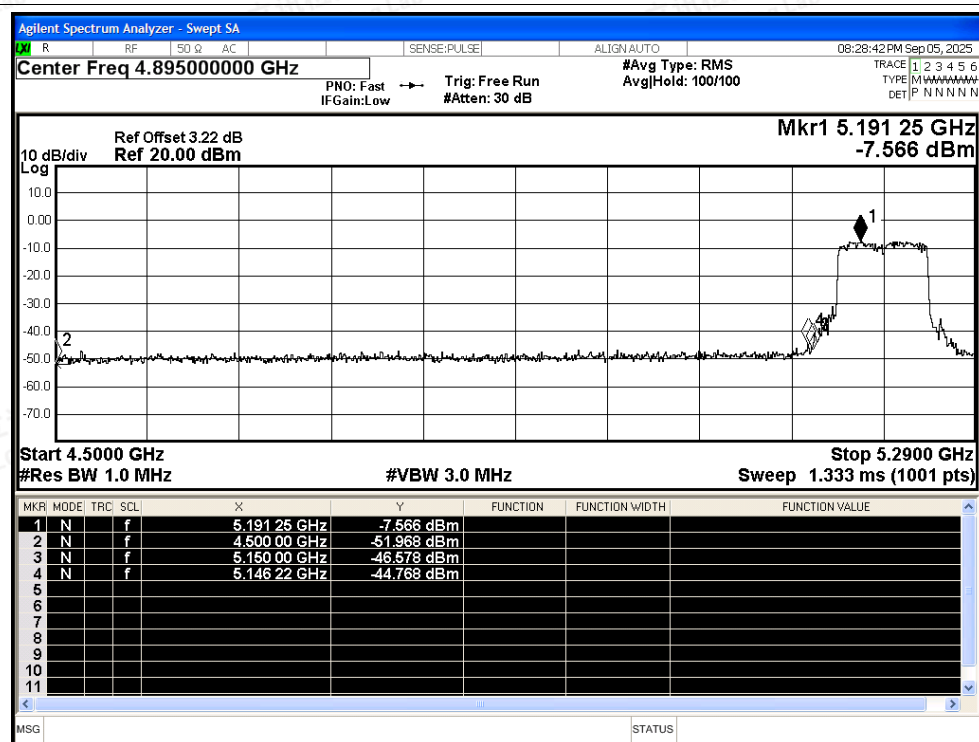

Restrict Band NVNT ax80 5210MHz Ant5 Average

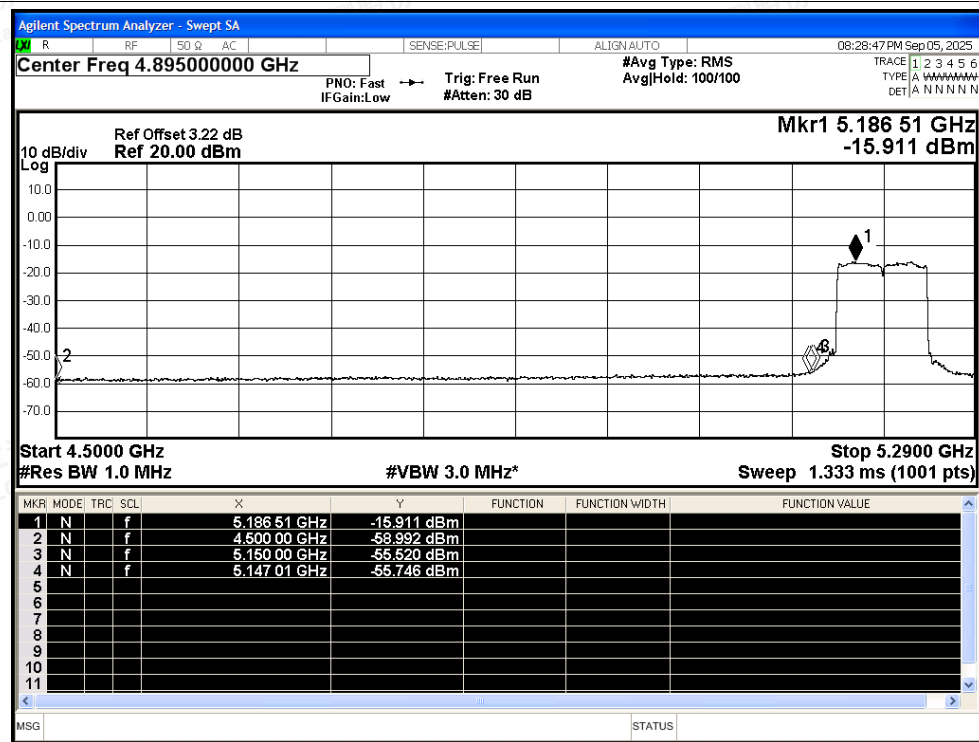

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5180MHz Ant5 Peak

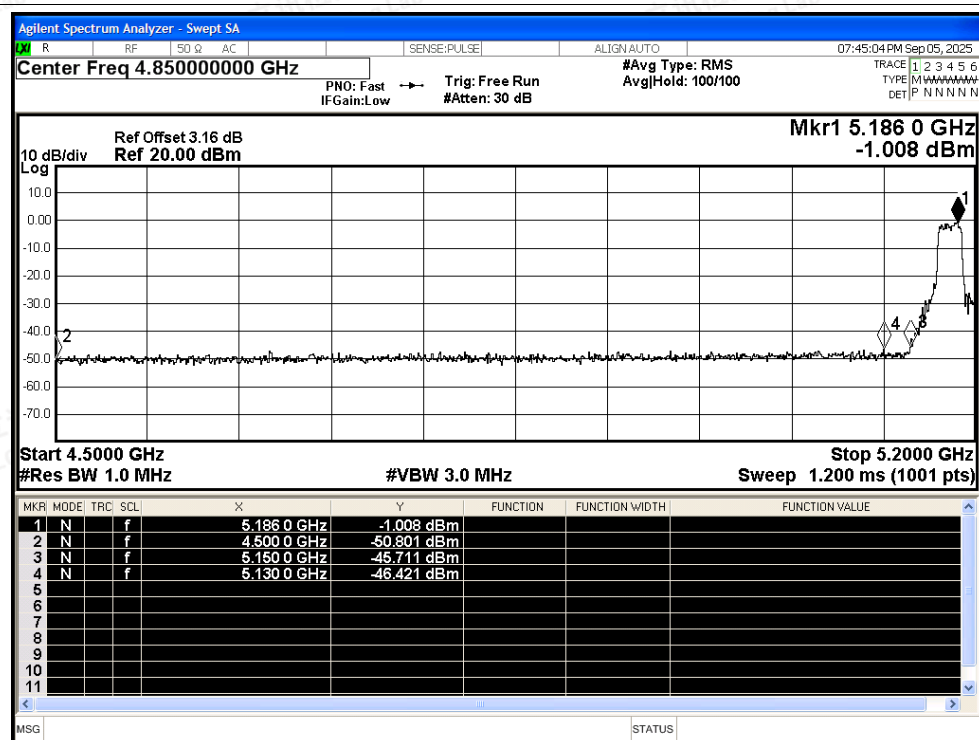

Restrict Band NVNT be20 5180MHz Ant5 Average

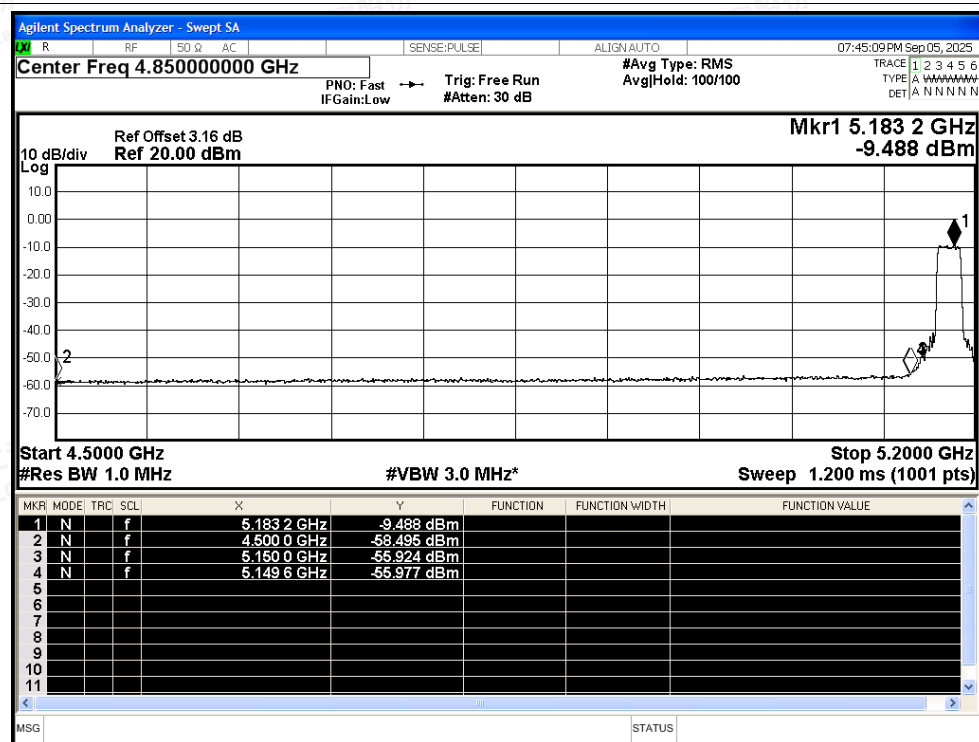

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5240MHz Ant5 Peak

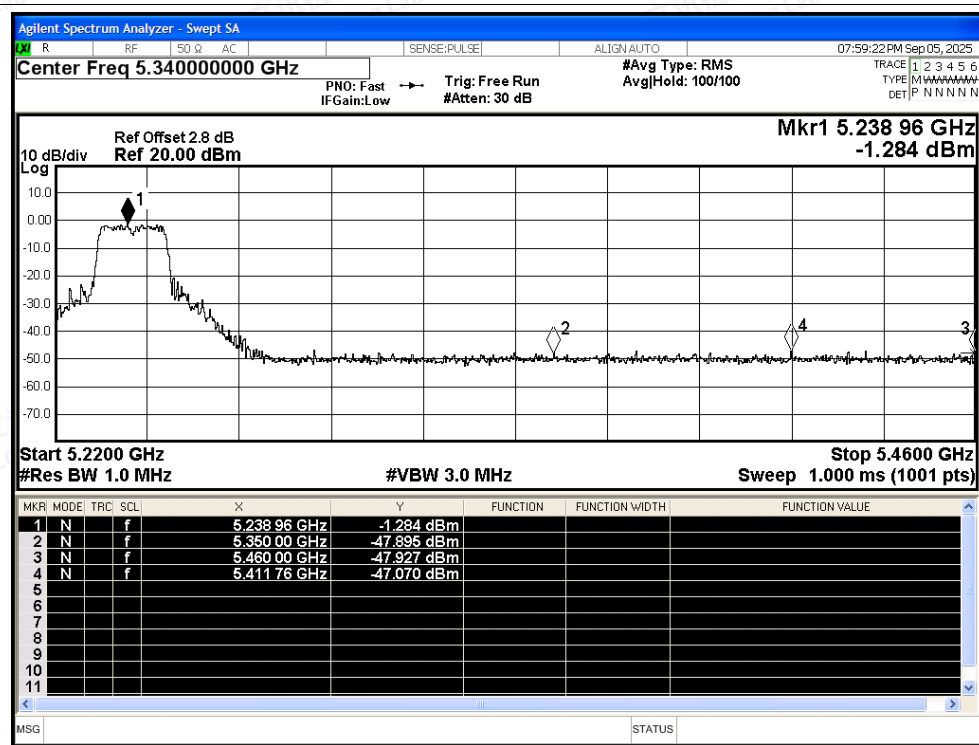


Restrict Band NVNT be20 5240MHz Ant5 Average

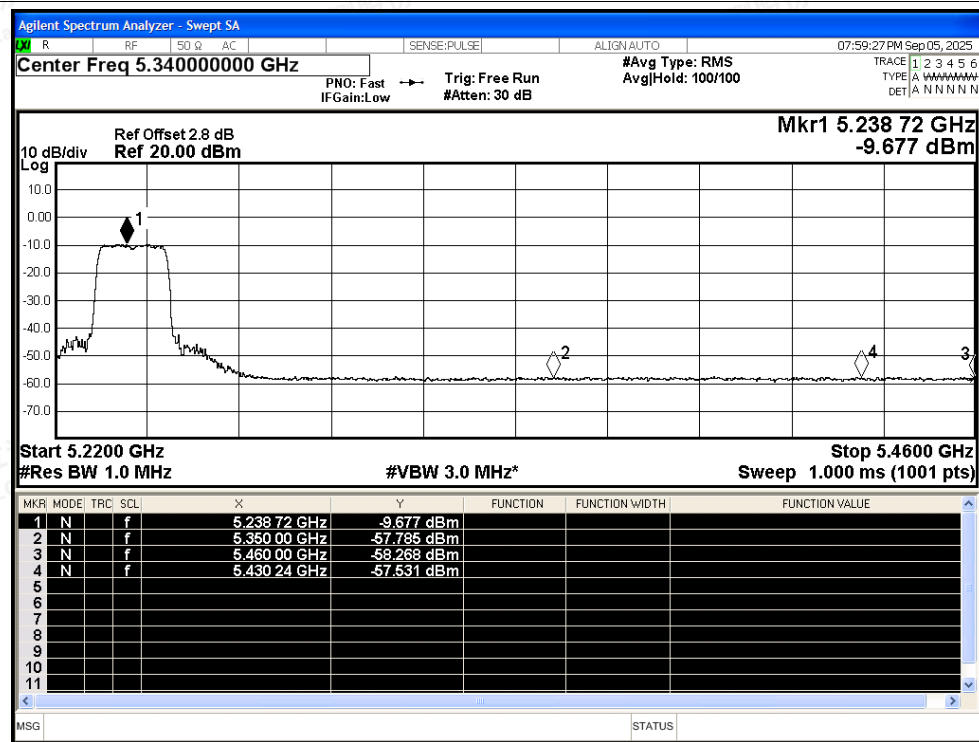




Restrict Band NVNT be40 5190MHz Ant5 Peak

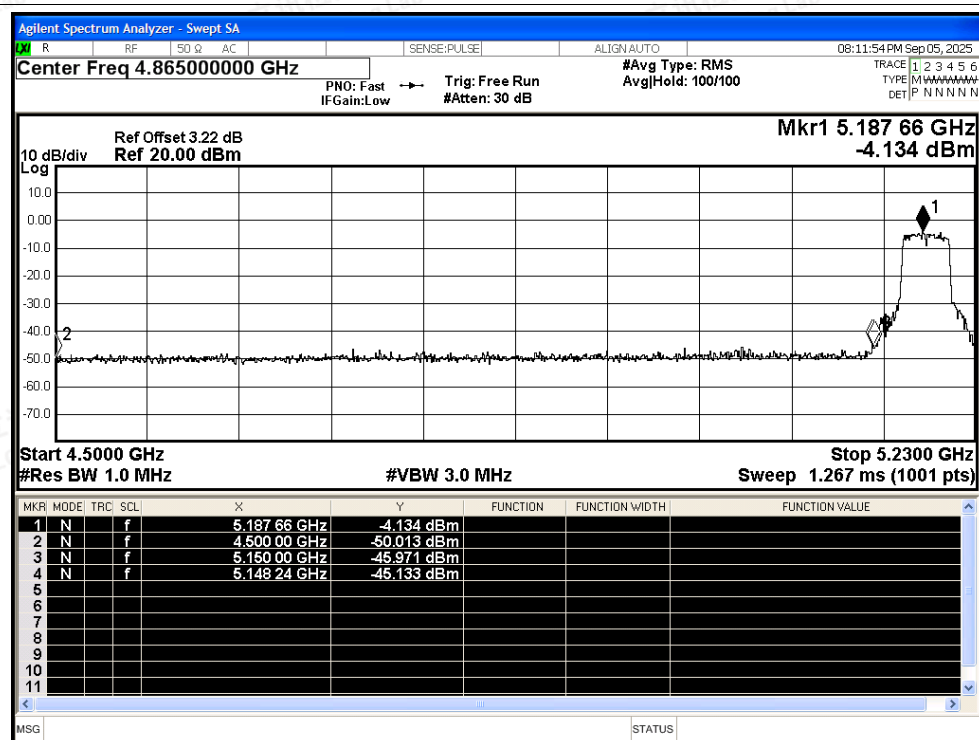

Restrict Band NVNT be40 5190MHz Ant5 Average

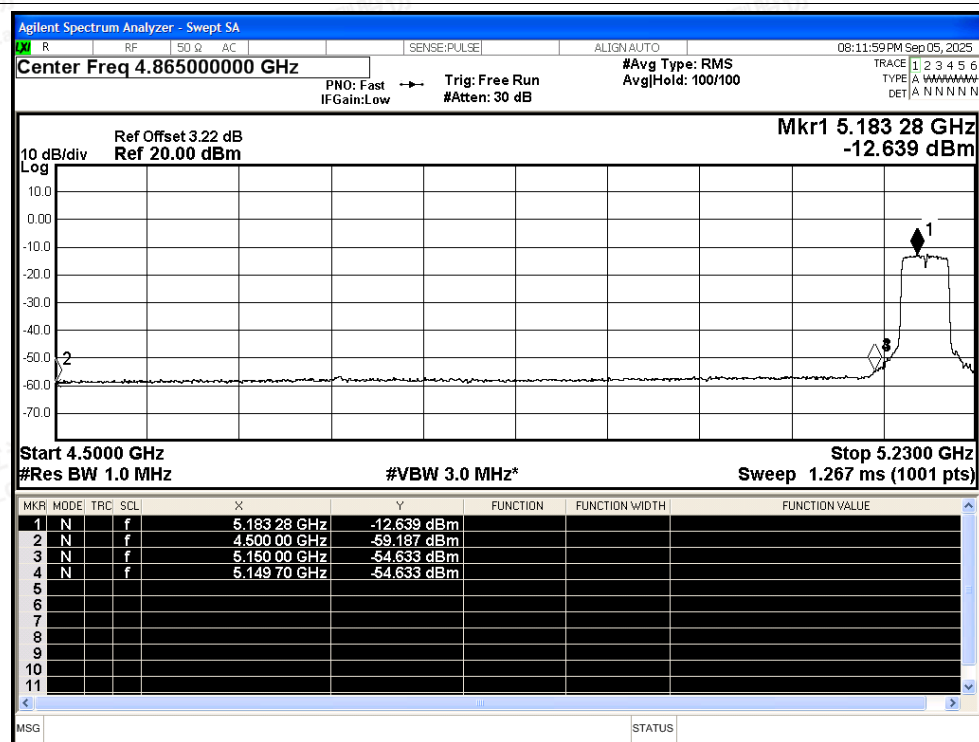

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5230MHz Ant5 Peak

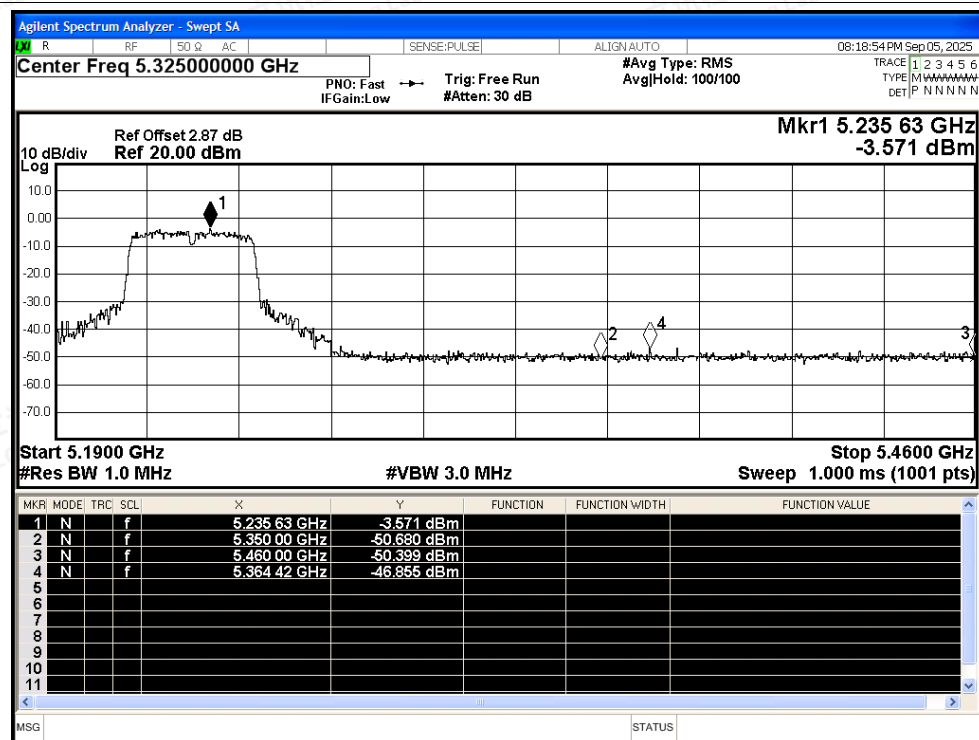

Restrict Band NVNT be40 5230MHz Ant5 Average

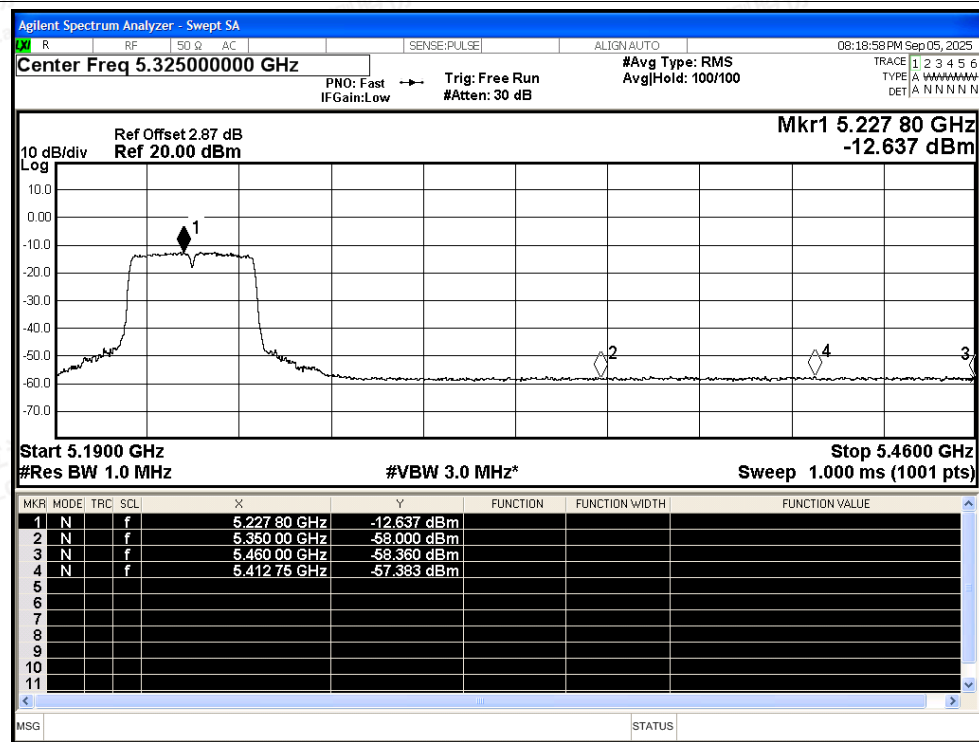

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5210MHz Ant5 Peak

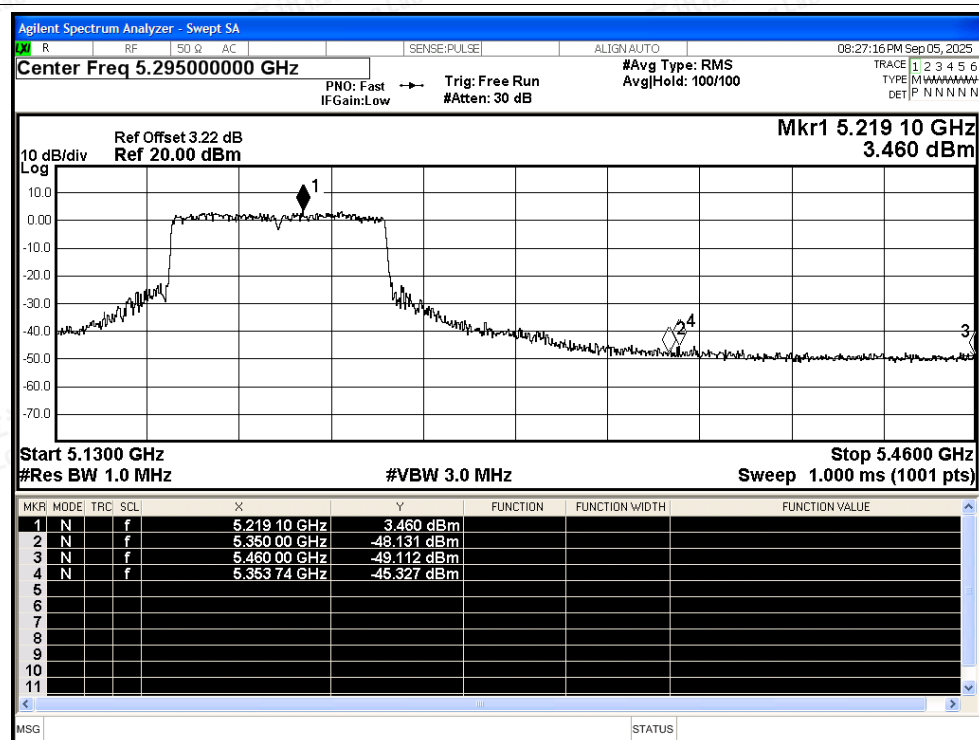

Restrict Band NVNT be80 5210MHz Ant5 Average

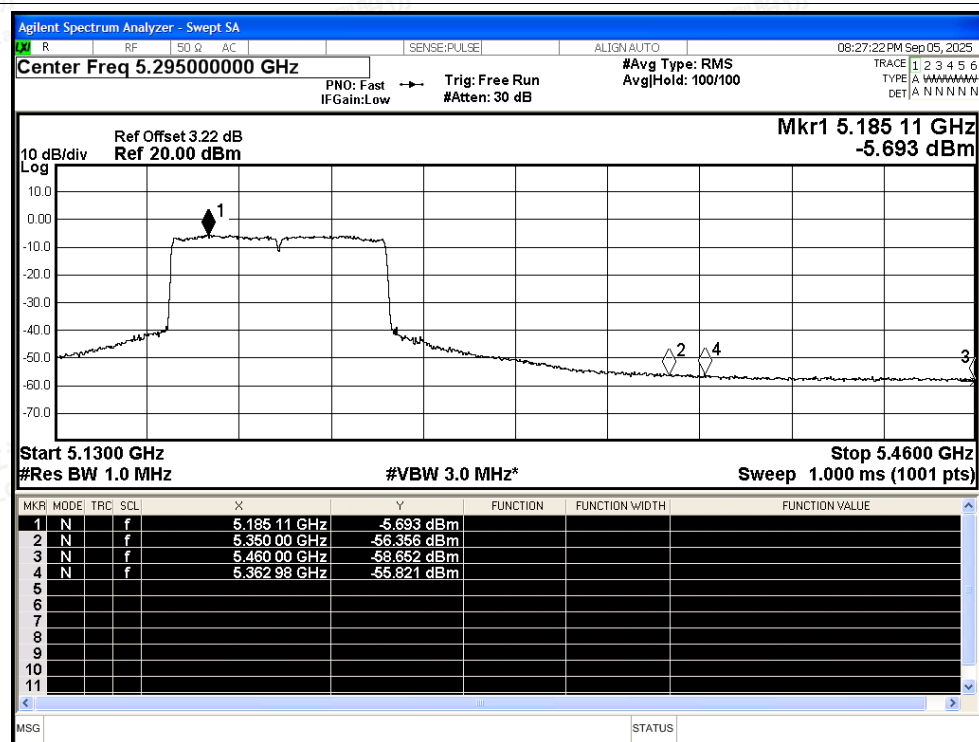

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5210MHz Ant5 Peak

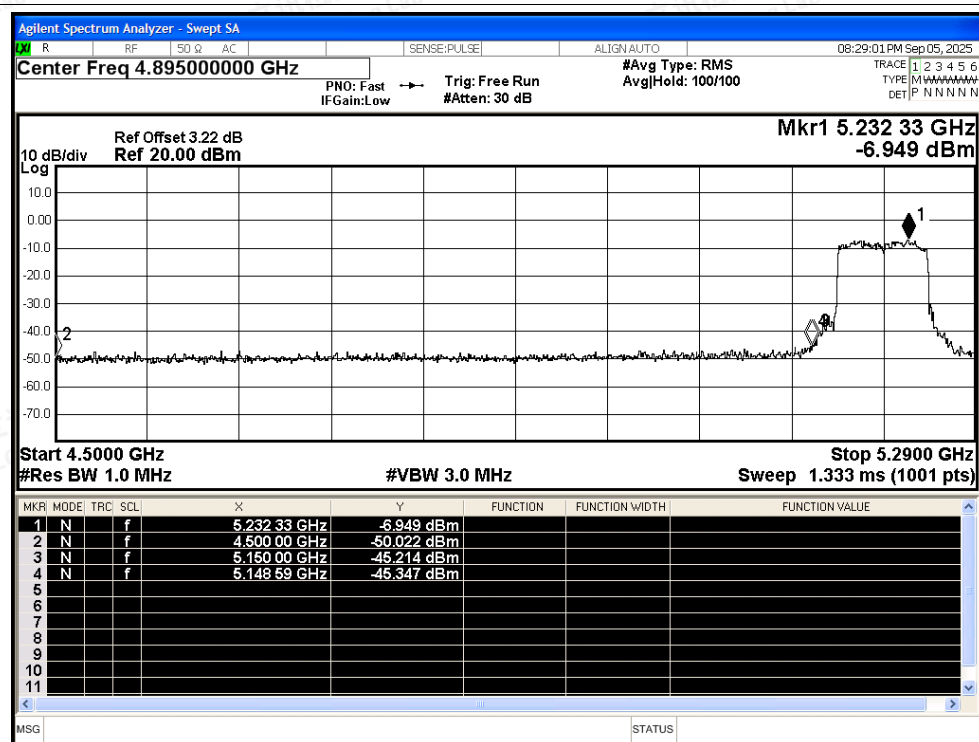

Restrict Band NVNT be80 5210MHz Ant5 Average

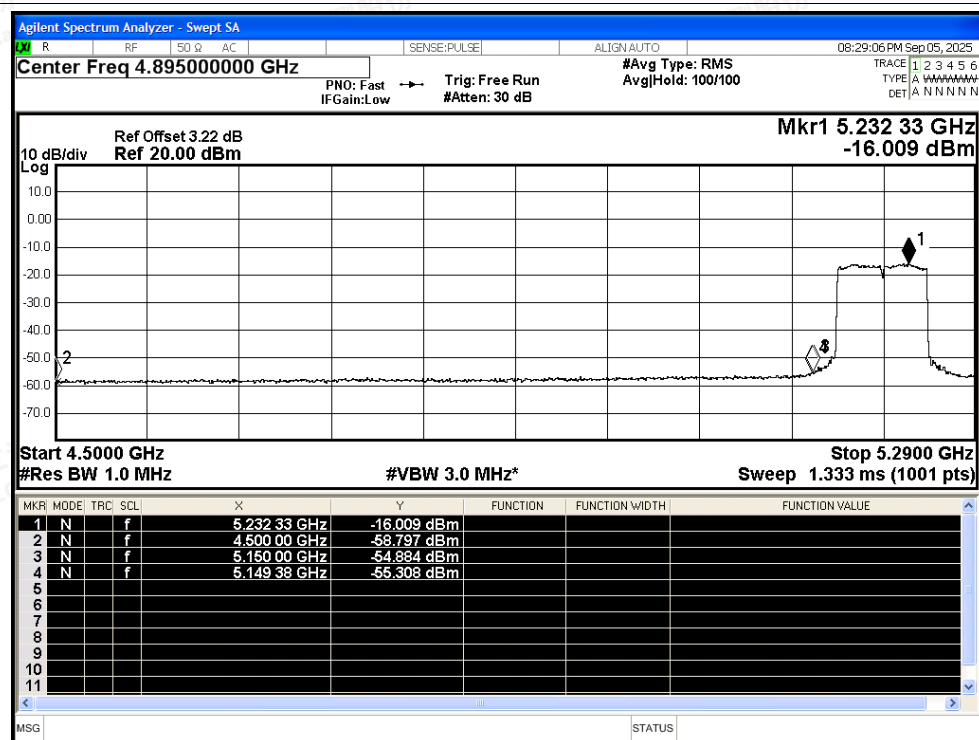

Restrict Band NVNT ac160 5250MHz Ant5 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

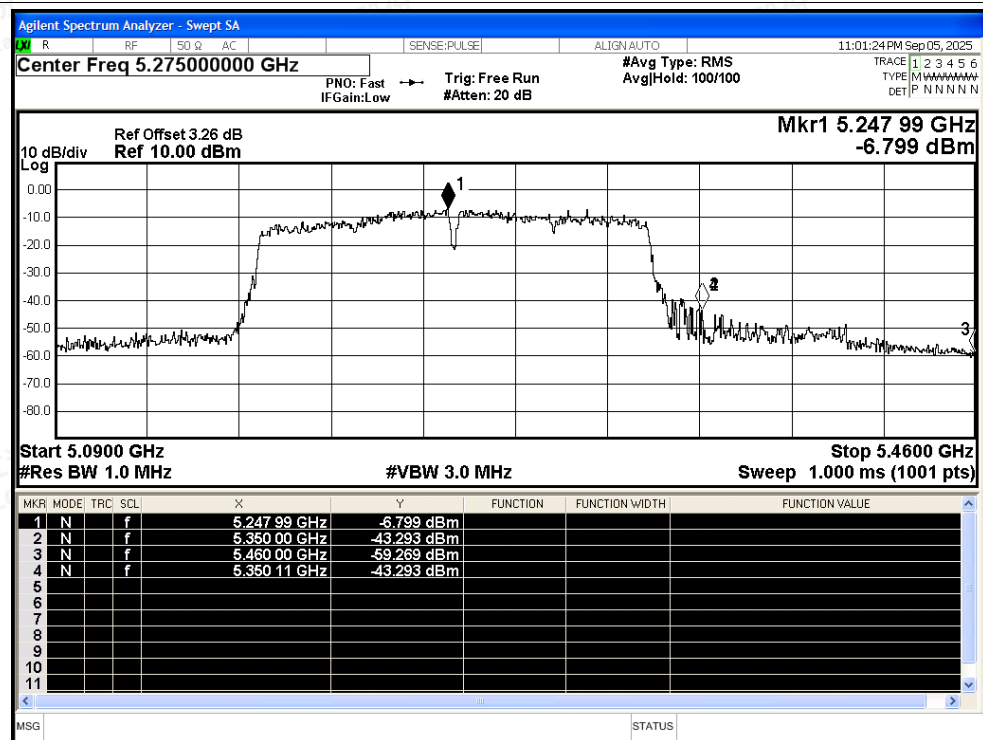


Restrict Band NVNT ac160 5250MHz Ant5 Average

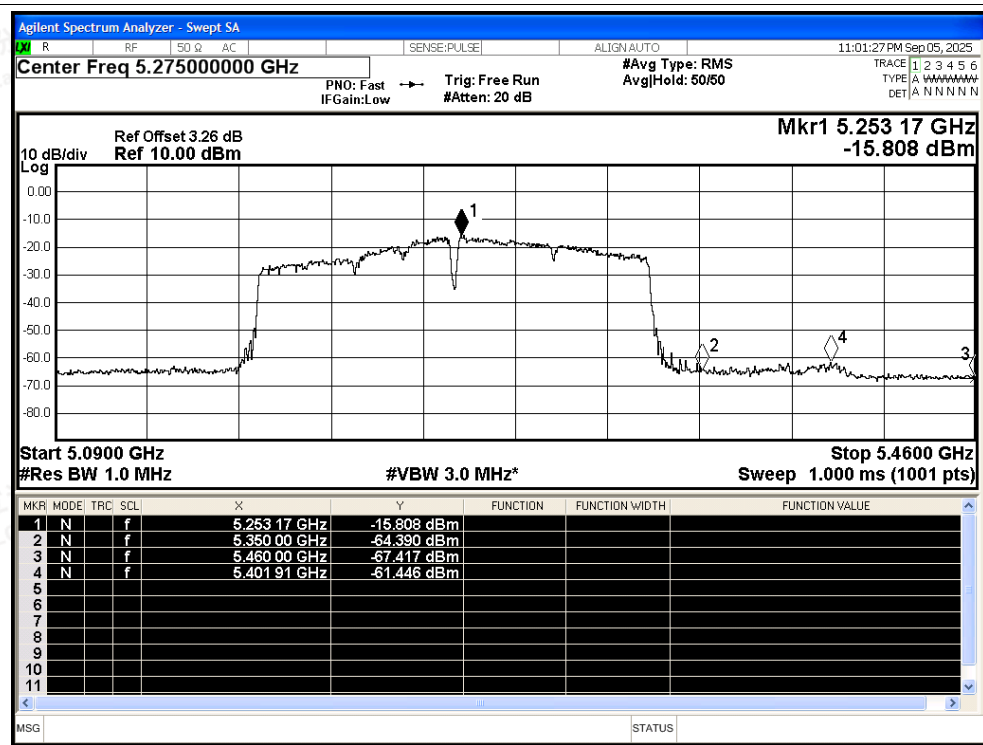




Restrict Band NVNT ac160 5250MHz Ant5 Peak

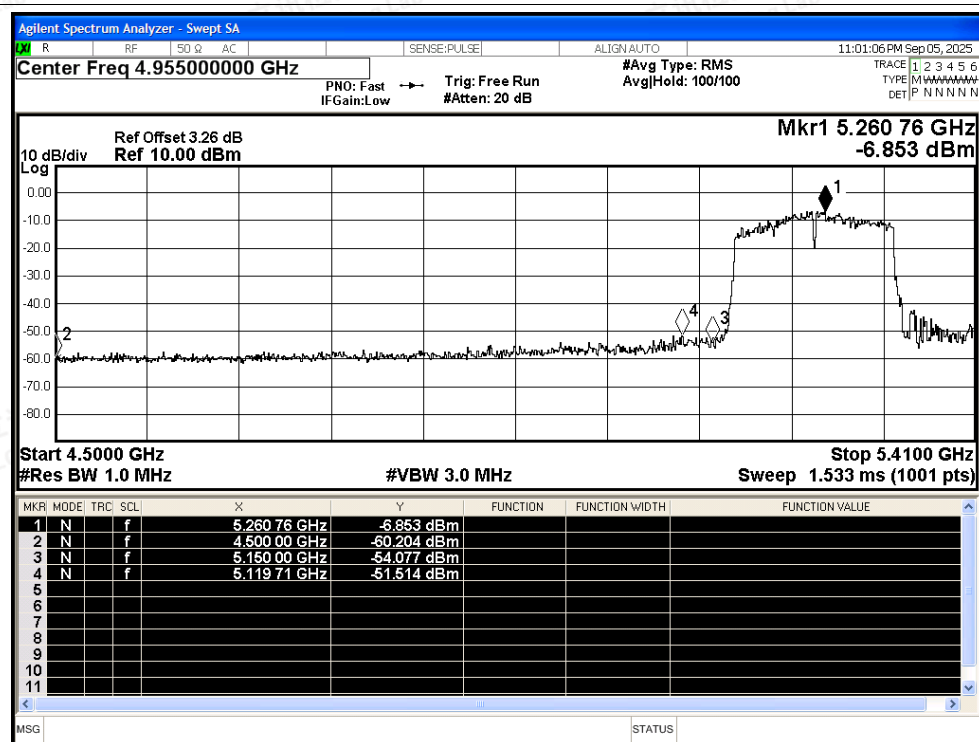

Restrict Band NVNT ac160 5250MHz Ant5 Average

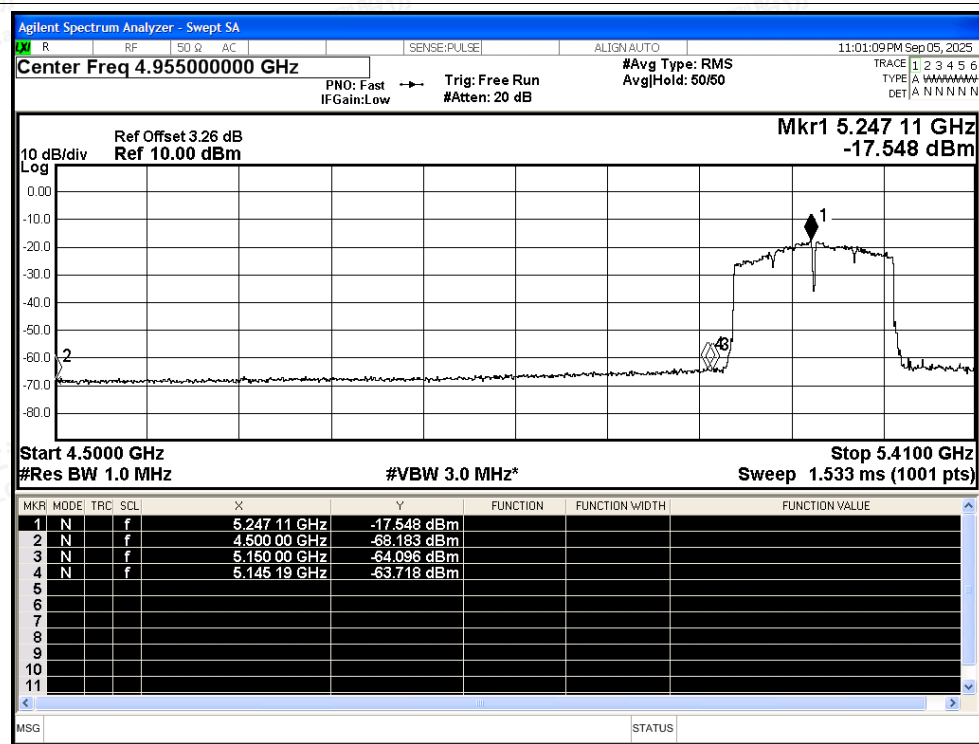

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant5 Peak

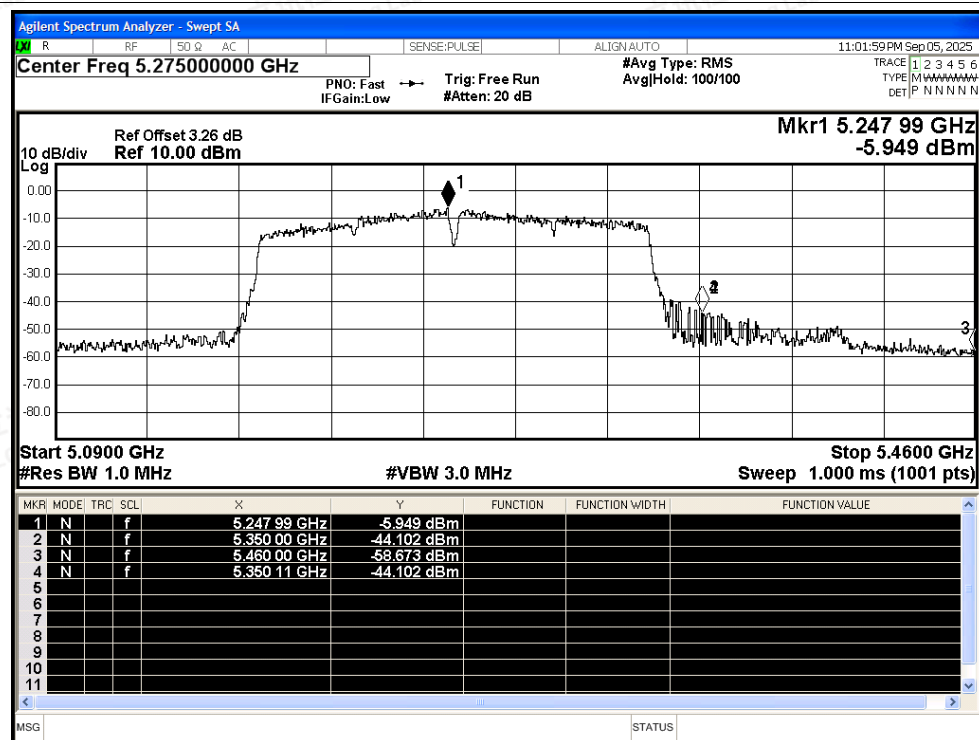


Restrict Band NVNT ax160 5250MHz Ant5 Average

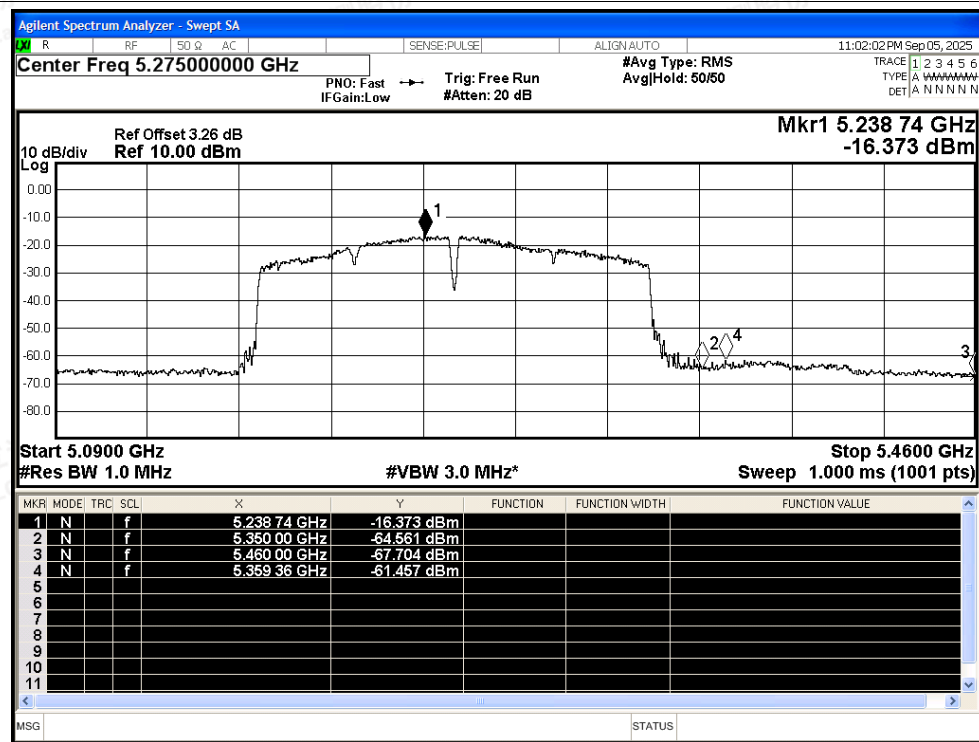




Restrict Band NVNT ax160 5250MHz Ant5 Peak

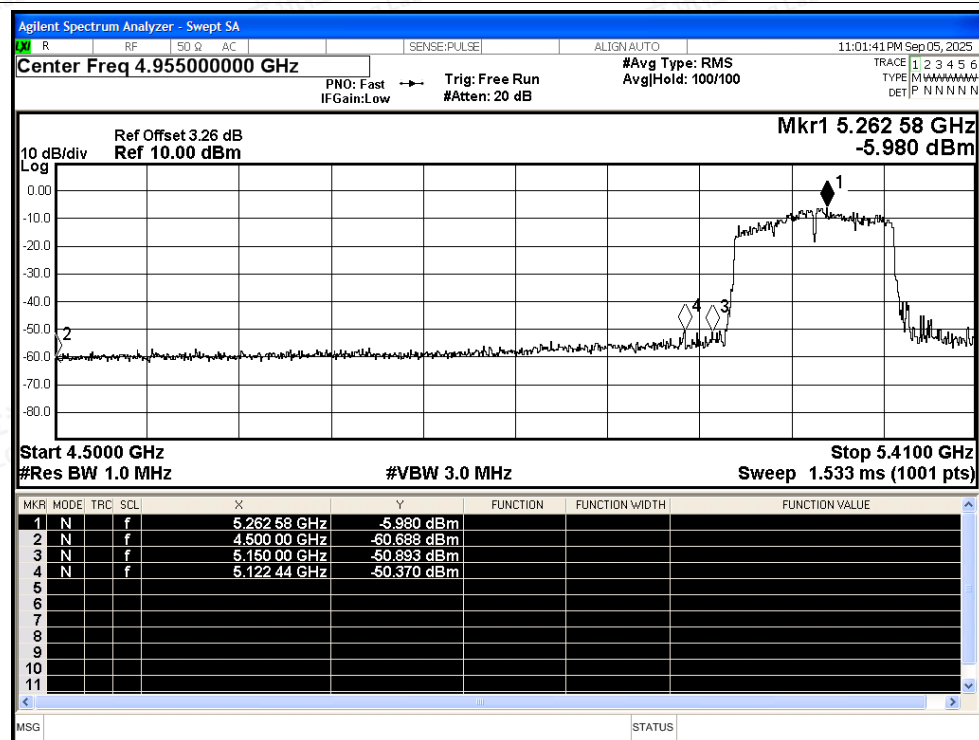


Restrict Band NVNT ax160 5250MHz Ant5 Average

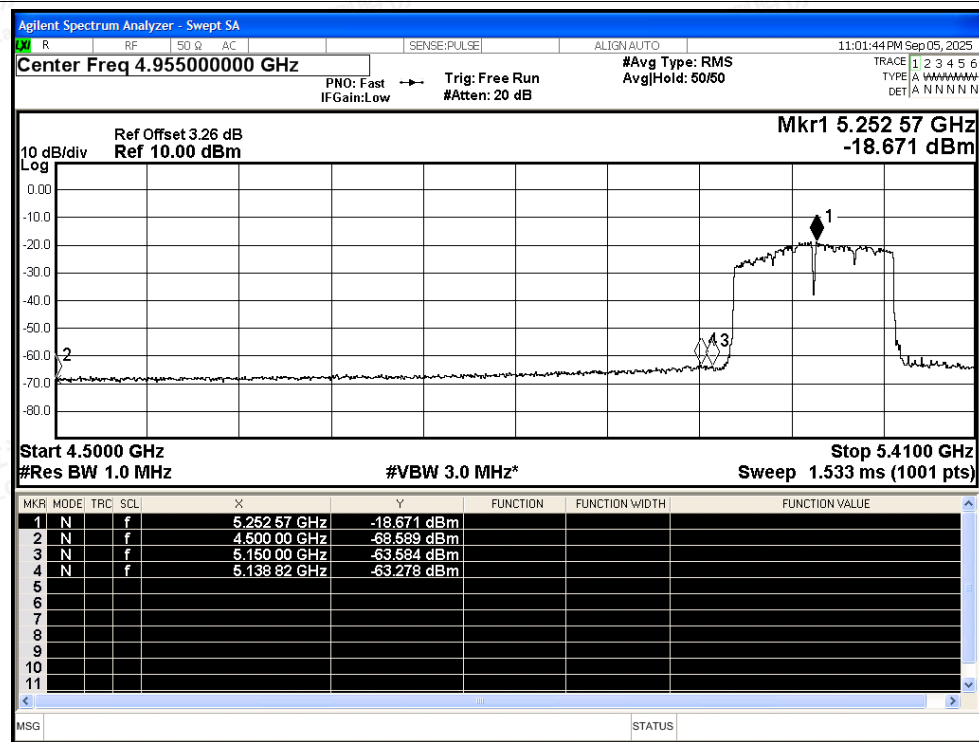




Restrict Band NVNT be160 5250MHz Ant5 Peak

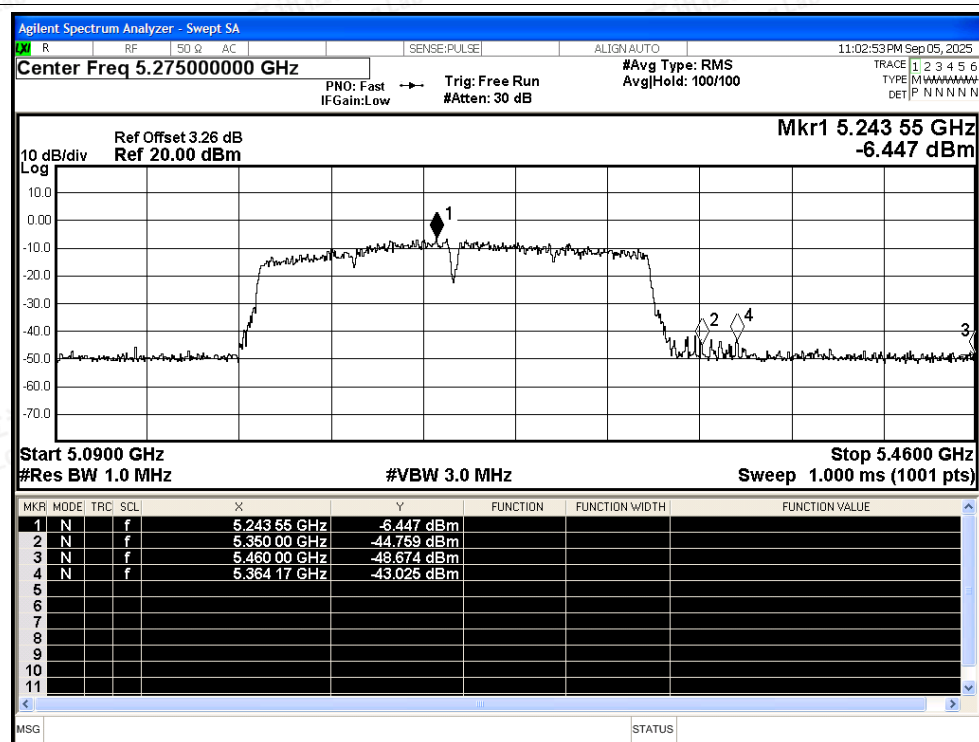

Restrict Band NVNT be160 5250MHz Ant5 Average

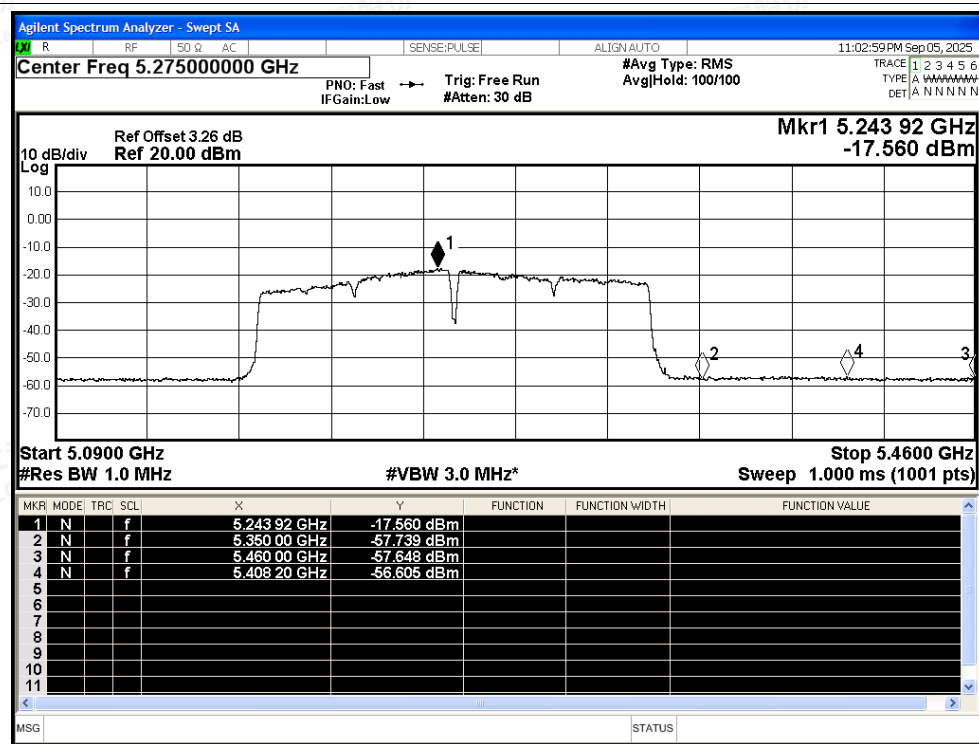

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be160 5250MHz Ant5 Peak

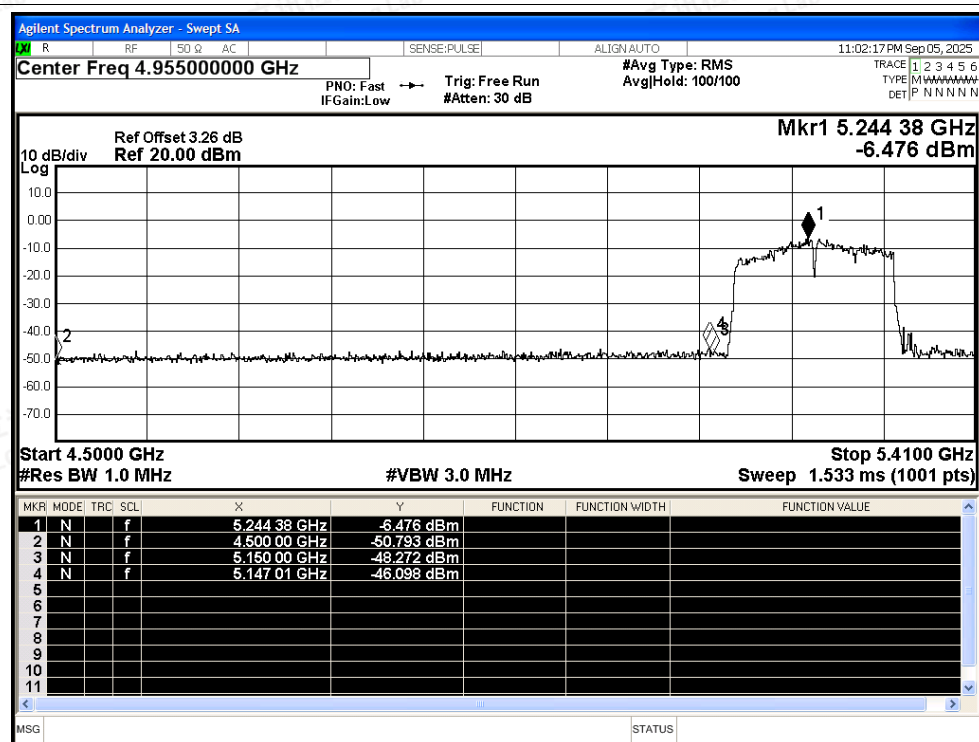

Restrict Band NVNT be160 5250MHz Ant5 Average

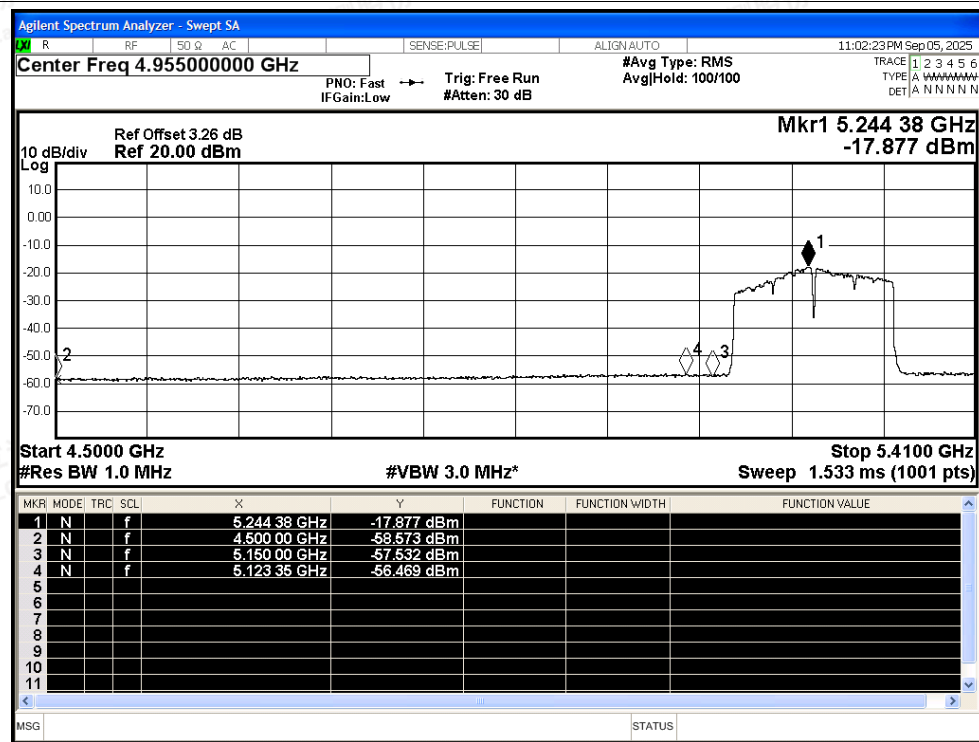

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant3 Power (dBm)	Ant4 Power (dBm)	Ant5 Power (dBm)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-49.62	-51.12	-50.46	9.05	58.69	Peak	68.2	Pass
NVNT	n20	5180	-58.69	-58.45	-58.59	9.05	50.47	Average	54	Pass
NVNT	n20	5180	-44.66	-46.02	-46.22	9.05	63.47	Peak	68.2	Pass
NVNT	n20	5180	-55.79	-56.07	-55.62	9.05	53.23	Average	54	Pass
NVNT	n20	5180	-44.74	-44.62	-46.12	9.05	63.94	Peak	68.2	Pass
NVNT	n20	5180	-55.68	-55.54	-55.43	9.05	53.50	Average	54	Pass
NVNT	n20	5240	-51.35	-49.58	-49.07	9.05	59.15	Peak	68.2	Pass
NVNT	n20	5240	-58.4	-58.02	-58.01	9.05	50.91	Average	54	Pass
NVNT	n20	5240	-46.23	-47.34	-47.53	9.05	62.05	Peak	68.2	Pass
NVNT	n20	5240	-57.29	-57.34	-57.53	9.05	51.66	Average	54	Pass
NVNT	n20	5240	-50.7	-49.77	-49.14	9.05	59.23	Peak	68.2	Pass
NVNT	n20	5240	-58.31	-58.18	-58	9.05	50.89	Average	54	Pass
NVNT	n40	5190	-51.14	-51.21	-49.54	9.05	58.49	Peak	68.2	Pass
NVNT	n40	5190	-58.91	-58.79	-58.76	9.05	50.23	Average	54	Pass
NVNT	n40	5190	-43.93	-42.62	-43.89	9.05	65.61	Peak	68.2	Pass
NVNT	n40	5190	-55.43	-55.45	-55.55	9.05	53.57	Average	54	Pass
NVNT	n40	5190	-45.77	-42.62	-43.89	9.05	65.14	Peak	68.2	Pass
NVNT	n40	5190	-55.46	-55.45	-55.67	9.05	53.52	Average	54	Pass
NVNT	n40	5230	-48.98	-48.19	-51.11	9.05	59.79	Peak	68.2	Pass
NVNT	n40	5230	-58.32	-58.46	-58.06	9.05	50.77	Average	54	Pass
NVNT	n40	5230	-47.46	-47.71	-47.46	9.05	61.51	Peak	68.2	Pass
NVNT	n40	5230	-57.47	-57.34	-57.37	9.05	51.66	Average	54	Pass
NVNT	n40	5230	-51.22	-51.52	-49.93	9.05	58.22	Peak	68.2	Pass
NVNT	n40	5230	-58.46	-57.7	-58.01	9.05	51.00	Average	54	Pass
NVNT	ac20	5180	-50.51	-50.7	-47.85	9.05	59.57	Peak	68.2	Pass
NVNT	ac20	5180	-58.75	-59.51	-58.79	9.05	50.05	Average	54	Pass
NVNT	ac20	5180	-45.2	-43.91	-40.5	9.05	66.32	Peak	68.2	Pass
NVNT	ac20	5180	-56.01	-55.97	-55.95	9.05	53.07	Average	54	Pass
NVNT	ac20	5180	-44.24	-44.9	-44.29	9.05	64.58	Peak	68.2	Pass
NVNT	ac20	5180	-55.11	-55.32	-55.07	9.05	53.88	Average	54	Pass
NVNT	ac20	5240	-49.21	-49.97	-48.79	9.05	59.75	Peak	68.2	Pass
NVNT	ac20	5240	-57.78	-58.44	-58.05	9.05	50.97	Average	54	Pass
NVNT	ac20	5240	-46.14	-47.61	-47.53	9.05	62.01	Peak	68.2	Pass
NVNT	ac20	5240	-57.44	-57.32	-57.53	9.05	51.62	Average	54	Pass
NVNT	ac20	5240	-50.57	-50.13	-48.95	9.05	59.22	Peak	68.2	Pass
NVNT	ac20	5240	-58.26	-58.58	-58.53	9.05	50.59	Average	54	Pass
NVNT	ac40	5190	-50.63	-50.83	-51.54	9.05	58.07	Peak	68.2	Pass
NVNT	ac40	5190	-58.59	-58.84	-58.32	9.05	50.47	Average	54	Pass
NVNT	ac40	5190	-45.36	-45.56	-45.4	9.05	63.61	Peak	68.2	Pass
NVNT	ac40	5190	-55.69	-55.05	-55.43	9.05	53.67	Average	54	Pass
NVNT	ac40	5190	-45.36	-45.56	-47.37	9.05	63.04	Peak	68.2	Pass
NVNT	ac40	5190	-56.34	-55.05	-55.43	9.05	53.48	Average	54	Pass
NVNT	ac40	5230	-49	-50.75	-48.3	9.05	59.82	Peak	68.2	Pass
NVNT	ac40	5230	-58.08	-58.36	-58.47	9.05	50.75	Average	54	Pass
NVNT	ac40	5230	-47.95	-47.33	-47.51	9.05	61.46	Peak	68.2	Pass
NVNT	ac40	5230	-57.25	-57.48	-57.21	9.05	51.74	Average	54	Pass
NVNT	ac40	5230	-51.09	-50.63	-51.47	9.05	58.00	Peak	68.2	Pass
NVNT	ac40	5230	-58.33	-58.06	-58.32	9.05	50.81	Average	54	Pass
NVNT	ac80	5210	-48.87	-48.04	-49.31	9.05	60.34	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5210	-56.43	-56.27	-56.92	9.05	52.52	Average	54	Pass
NVNT	ac80	5210	-45.61	-45.32	-46.7	9.05	63.21	Peak	68.2	Pass
NVNT	ac80	5210	-55.9	-55.65	-55.79	9.05	53.27	Average	54	Pass
NVNT	ac80	5210	-49.63	-49.57	-49.16	9.05	59.60	Peak	68.2	Pass
NVNT	ac80	5210	-58.04	-58.13	-58.13	9.05	50.95	Average	54	Pass
NVNT	ac80	5210	-49.94	-50.2	-49.05	9.05	59.35	Peak	68.2	Pass
NVNT	ac80	5210	-58.44	-58.45	-58.47	9.05	50.60	Average	54	Pass
NVNT	ac80	5210	-44.18	-44.72	-45.01	9.05	64.43	Peak	68.2	Pass
NVNT	ac80	5210	-55.13	-55.41	-55.46	9.05	53.72	Average	54	Pass
NVNT	ac80	5210	-45.55	-47.18	-48.9	9.05	62.05	Peak	68.2	Pass
NVNT	ac80	5210	-55.44	-55.54	-55.04	9.05	53.71	Average	54	Pass
NVNT	ax20	5180	-50.3	-49.69	-50.53	9.05	58.89	Peak	68.2	Pass
NVNT	ax20	5180	-59.04	-58.97	-58.82	9.05	50.11	Average	54	Pass
NVNT	ax20	5180	-44.79	-43.8	-45.61	9.05	64.38	Peak	68.2	Pass
NVNT	ax20	5180	-55.82	-55.64	-55.94	9.05	53.25	Average	54	Pass
NVNT	ax20	5180	-46.14	-46.22	-43.54	9.05	63.94	Peak	68.2	Pass
NVNT	ax20	5180	-55.92	-55.58	-56.22	9.05	53.15	Average	54	Pass
NVNT	ax20	5240	-49.72	-50.26	-50.05	9.05	59.04	Peak	68.2	Pass
NVNT	ax20	5240	-58.48	-58.13	-58.66	9.05	50.63	Average	54	Pass
NVNT	ax20	5240	-47.67	-46.86	-47.62	9.05	61.68	Peak	68.2	Pass
NVNT	ax20	5240	-57.46	-57.31	-57.46	9.05	51.64	Average	54	Pass
NVNT	ax20	5240	-49.49	-48.82	-49.93	9.05	59.66	Peak	68.2	Pass
NVNT	ax20	5240	-58.54	-58.48	-58.57	9.05	50.52	Average	54	Pass
NVNT	ax40	5190	-50.2	-50.56	-50.23	9.05	58.72	Peak	68.2	Pass
NVNT	ax40	5190	-59.05	-58.81	-58.67	9.05	50.21	Average	54	Pass
NVNT	ax40	5190	-44.88	-44.67	-42.93	9.05	64.98	Peak	68.2	Pass
NVNT	ax40	5190	-55.24	-55.29	-55.37	9.05	53.75	Average	54	Pass
NVNT	ax40	5190	-44.88	-44.92	-42.93	9.05	64.91	Peak	68.2	Pass
NVNT	ax40	5190	-55.96	-55.68	-55.37	9.05	53.39	Average	54	Pass
NVNT	ax40	5230	-49.94	-50.22	-50.11	9.05	58.96	Peak	68.2	Pass
NVNT	ax40	5230	-58.72	-58.42	-57.75	9.05	50.77	Average	54	Pass
NVNT	ax40	5230	-47.29	-47.58	-47.23	9.05	61.68	Peak	68.2	Pass
NVNT	ax40	5230	-57.33	-57.47	-57.27	9.05	51.69	Average	54	Pass
NVNT	ax40	5230	-49.13	-49.4	-48.9	9.05	59.91	Peak	68.2	Pass
NVNT	ax40	5230	-58.44	-58.49	-58.51	9.05	50.57	Average	54	Pass
NVNT	ax80	5210	-48.5	-47.18	-47.67	9.05	61.30	Peak	68.2	Pass
NVNT	ax80	5210	-56.45	-56.18	-56.38	9.05	52.71	Average	54	Pass
NVNT	ax80	5210	-45.07	-46.04	-46.39	9.05	63.25	Peak	68.2	Pass
NVNT	ax80	5210	-55.98	-55.65	-55.85	9.05	53.22	Average	54	Pass
NVNT	ax80	5210	-50.77	-49.5	-49.42	9.05	59.19	Peak	68.2	Pass
NVNT	ax80	5210	-57.84	-57.34	-57.82	9.05	51.39	Average	54	Pass
NVNT	ax80	5210	-50.43	-50.22	-51.97	9.05	58.24	Peak	68.2	Pass
NVNT	ax80	5210	-58.78	-58.85	-58.99	9.05	50.18	Average	54	Pass
NVNT	ax80	5210	-44.12	-45.18	-44.77	9.05	64.38	Peak	68.2	Pass
NVNT	ax80	5210	-55.78	-55.3	-55.75	9.05	53.44	Average	54	Pass
NVNT	ax80	5210	-46.28	-45.03	-46.58	9.05	63.14	Peak	68.2	Pass
NVNT	ax80	5210	-55.14	-54.93	-55.52	9.05	53.86	Average	54	Pass
NVNT	be20	5180	-48.62	-51.52	-50.8	9.05	58.92	Peak	68.2	Pass
NVNT	be20	5180	-59.17	-58.99	-58.5	9.05	50.17	Average	54	Pass
NVNT	be20	5180	-44.5	-45.82	-46.42	9.05	63.54	Peak	68.2	Pass
NVNT	be20	5180	-56.32	-55.48	-55.98	9.05	53.14	Average	54	Pass
NVNT	be20	5180	-41.66	-46.09	-45.71	9.05	65.06	Peak	68.2	Pass
NVNT	be20	5180	-55.71	-55.73	-55.92	9.05	53.26	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	be20	5240	-51.05	-51.03	-47.9	9.05	59.32	Peak	68.2	Pass
NVNT	be20	5240	-58.35	-58.51	-57.79	9.05	50.84	Average	54	Pass
NVNT	be20	5240	-47.9	-47.48	-47.07	9.05	61.58	Peak	68.2	Pass
NVNT	be20	5240	-57.48	-57.36	-57.53	9.05	51.59	Average	54	Pass
NVNT	be20	5240	-50.53	-49.18	-47.93	9.05	59.96	Peak	68.2	Pass
NVNT	be20	5240	-58.4	-58.73	-58.27	9.05	50.59	Average	54	Pass
NVNT	be40	5190	-50.87	-50.51	-50.01	9.05	58.60	Peak	68.2	Pass
NVNT	be40	5190	-58.91	-58.78	-59.19	9.05	50.09	Average	54	Pass
NVNT	be40	5190	-45.2	-41.01	-45.13	9.05	65.74	Peak	68.2	Pass
NVNT	be40	5190	-55.24	-55.25	-54.71	9.05	53.99	Average	54	Pass
NVNT	be40	5190	-45.2	-42.07	-45.97	9.05	64.98	Peak	68.2	Pass
NVNT	be40	5190	-55.24	-55.89	-54.63	9.05	53.83	Average	54	Pass
NVNT	be40	5230	-49.9	-49.13	-50.68	9.05	59.19	Peak	68.2	Pass
NVNT	be40	5230	-57.61	-57.82	-58	9.05	51.24	Average	54	Pass
NVNT	be40	5230	-47.79	-46.97	-46.86	9.05	61.86	Peak	68.2	Pass
NVNT	be40	5230	-57.36	-57.39	-57.38	9.05	51.67	Average	54	Pass
NVNT	be40	5230	-49.81	-50.98	-50.4	9.05	58.68	Peak	68.2	Pass
NVNT	be40	5230	-58.09	-58.35	-58.36	9.05	50.78	Average	54	Pass
NVNT	be80	5210	-47.25	-48.83	-48.13	9.05	61.03	Peak	68.2	Pass
NVNT	be80	5210	-55.96	-56.17	-56.36	9.05	52.89	Average	54	Pass
NVNT	be80	5210	-46.5	-45.54	-45.33	9.05	63.29	Peak	68.2	Pass
NVNT	be80	5210	-55.79	-55.93	-55.82	9.05	53.20	Average	54	Pass
NVNT	be80	5210	-48.98	-50.35	-49.11	9.05	59.61	Peak	68.2	Pass
NVNT	be80	5210	-57.61	-57.65	-58.65	9.05	51.10	Average	54	Pass
NVNT	be80	5210	-51.16	-51.32	-50.02	9.05	58.26	Peak	68.2	Pass
NVNT	be80	5210	-58.9	-58.64	-58.8	9.05	50.27	Average	54	Pass
NVNT	be80	5210	-43.11	-45.94	-45.35	9.05	64.43	Peak	68.2	Pass
NVNT	be80	5210	-55.55	-55.7	-55.31	9.05	53.53	Average	54	Pass
NVNT	be80	5210	-42.21	-45.98	-45.21	9.05	64.90	Peak	68.2	Pass
NVNT	be80	5210	-55.57	-55.91	-54.88	9.05	53.62	Average	54	Pass
NVNT	ac160	5250	-55.63	-53.94	-43.29	9.05	61.57	Peak	68.2	Pass
NVNT	ac160	5250	-63.8	-64.43	-64.39	9.05	44.85	Average	54	Pass
NVNT	ac160	5250	-45.11	-43.97	-43.29	9.05	64.99	Peak	68.2	Pass
NVNT	ac160	5250	-62.28	-62.24	-61.45	9.05	47.08	Average	54	Pass
NVNT	ac160	5250	-59.59	-56.8	-59.27	9.05	50.68	Peak	68.2	Pass
NVNT	ac160	5250	-67.38	-66.73	-67.42	9.05	41.88	Average	54	Pass
NVNT	ac160	5250	-60.19	-60.46	-60.2	9.05	48.77	Peak	68.2	Pass
NVNT	ac160	5250	-68.47	-68.79	-68.18	9.05	40.58	Average	54	Pass
NVNT	ac160	5250	-44.5	-47.44	-51.51	9.05	62.10	Peak	68.2	Pass
NVNT	ac160	5250	-58.98	-63.33	-63.72	9.05	47.61	Average	54	Pass
NVNT	ac160	5250	-47.62	-54.26	-54.08	9.05	58.25	Peak	68.2	Pass
NVNT	ac160	5250	-60.31	-64.03	-64.1	9.05	46.62	Average	54	Pass
NVNT	ax160	5250	-52.17	-53.28	-44.1	9.05	61.24	Peak	68.2	Pass
NVNT	ax160	5250	-64.31	-64.51	-64.56	9.05	44.59	Average	54	Pass
NVNT	ax160	5250	-44.31	-43.68	-44.1	9.05	65.03	Peak	68.2	Pass
NVNT	ax160	5250	-60.73	-60.97	-61.46	9.05	48.01	Average	54	Pass
NVNT	ax160	5250	-56.23	-58.27	-58.67	9.05	51.46	Peak	68.2	Pass
NVNT	ax160	5250	-67.03	-67.14	-67.7	9.05	41.77	Average	54	Pass
NVNT	ax160	5250	-59.42	-60.14	-60.69	9.05	49.00	Peak	68.2	Pass
NVNT	ax160	5250	-67.9	-68.82	-68.59	9.05	40.63	Average	54	Pass
NVNT	ax160	5250	-44.79	-49.97	-50.37	9.05	61.47	Peak	68.2	Pass
NVNT	ax160	5250	-58.02	-61.63	-63.28	9.05	48.65	Average	54	Pass
NVNT	ax160	5250	-49.55	-53.45	-50.89	9.05	58.04	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax160	5250	-60.08	-62.24	-63.58	9.05	47.33	Average	54	Pass
NVNT	be160	5250	-42.49	-49.96	-44.76	9.05	64.27	Peak	68.2	Pass
NVNT	be160	5250	-57.73	-57.72	-57.74	9.05	51.32	Average	54	Pass
NVNT	be160	5250	-42.49	-43.64	-43.03	9.05	66.02	Peak	68.2	Pass
NVNT	be160	5250	-56.46	-56.09	-56.61	9.05	52.67	Average	54	Pass
NVNT	be160	5250	-49.12	-49.92	-48.67	9.05	59.84	Peak	68.2	Pass
NVNT	be160	5250	-57.75	-57.83	-57.65	9.05	51.31	Average	54	Pass
NVNT	be160	5250	-50.15	-50.25	-50.79	9.05	58.66	Peak	68.2	Pass
NVNT	be160	5250	-58.8	-58.6	-58.57	9.05	50.39	Average	54	Pass
NVNT	be160	5250	-44.57	-46.03	-46.1	9.05	63.54	Peak	68.2	Pass
NVNT	be160	5250	-55.42	-56.31	-56.47	9.05	53.01	Average	54	Pass
NVNT	be160	5250	-47.15	-48.57	-48.27	9.05	61.10	Peak	68.2	Pass
NVNT	be160	5250	-55.94	-57.2	-57.53	9.05	52.21	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



B.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant3	5200	0	0	25	Pass
NVNT	a	5240	Ant3	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant3	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant3	5240	0	0	25	Pass
NVNT	n40	5190	Ant3	5190	0	0	25	Pass
NVNT	n40	5230	Ant3	5230	0	0	25	Pass
NVNT	ac20	5180	Ant3	5179.96	-40000	-7.72	25	Pass
NVNT	ac20	5200	Ant3	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant3	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant3	5190	0	0	25	Pass
NVNT	ac40	5230	Ant3	5230	0	0	25	Pass
NVNT	ac80	5210	Ant3	5210	0	0	25	Pass
NVNT	ax20	5180	Ant3	5180	0	0	25	Pass
NVNT	ax20	5200	Ant3	5199.96	-40000	-7.69	25	Pass
NVNT	ax20	5240	Ant3	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant3	5190	0	0	25	Pass
NVNT	ax40	5230	Ant3	5229.96	-40000	-7.65	25	Pass
NVNT	ax80	5210	Ant3	5210	0	0	25	Pass
NVNT	be20	5180	Ant3	5180	0	0	25	Pass
NVNT	be20	5200	Ant3	5199.98	-20000	-3.85	25	Pass
NVNT	be20	5240	Ant3	5240	0	0	25	Pass
NVNT	be40	5190	Ant3	5190	0	0	25	Pass
NVNT	be40	5230	Ant3	5229.96	-40000	-7.65	25	Pass
NVNT	be80	5210	Ant3	5210	0	0	25	Pass
NVNT	ac160	5250	Ant3	5250	0	0	25	Pass
NVNT	ax160	5250	Ant3	5250	0	0	25	Pass
NVNT	be160	5250	Ant3	5250	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant3

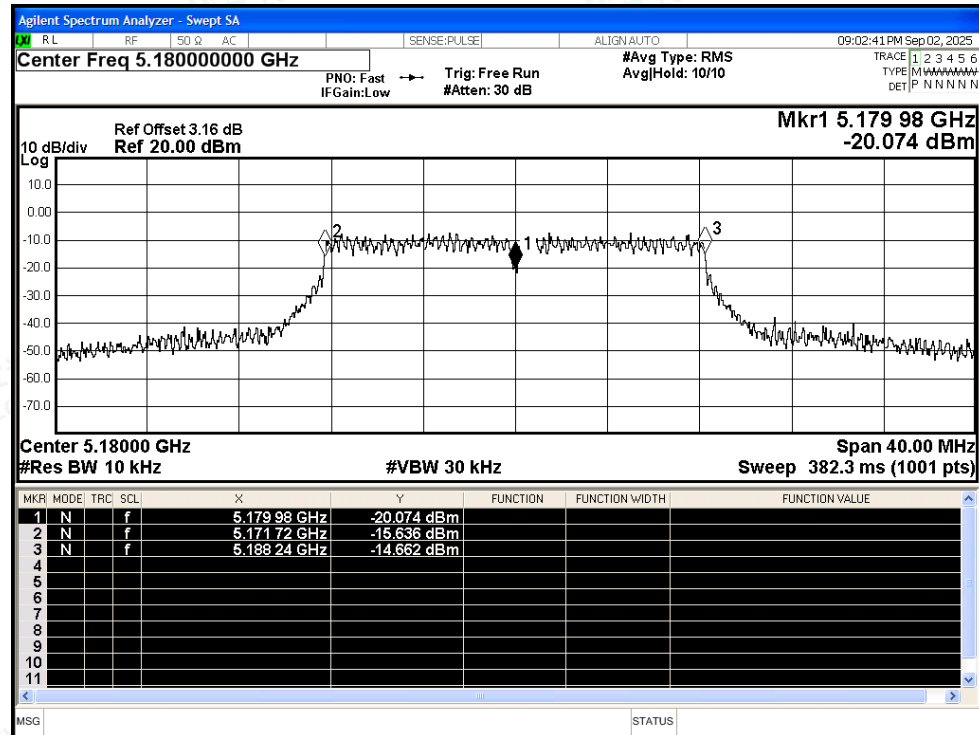

Freq. Stability NVNT a 5200MHz Ant3

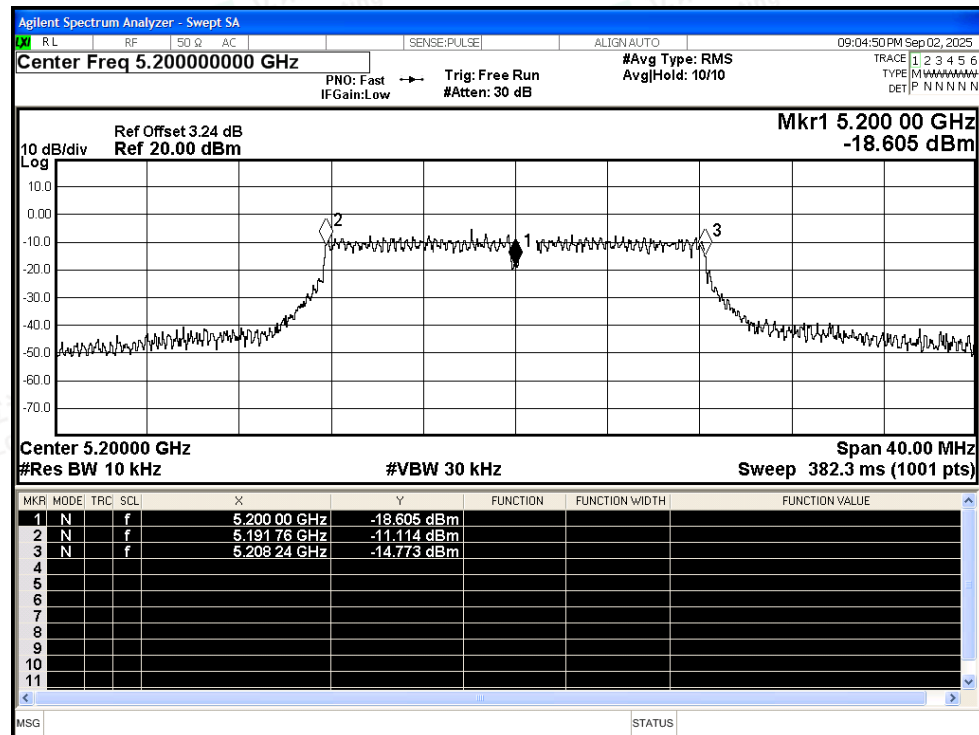

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant3

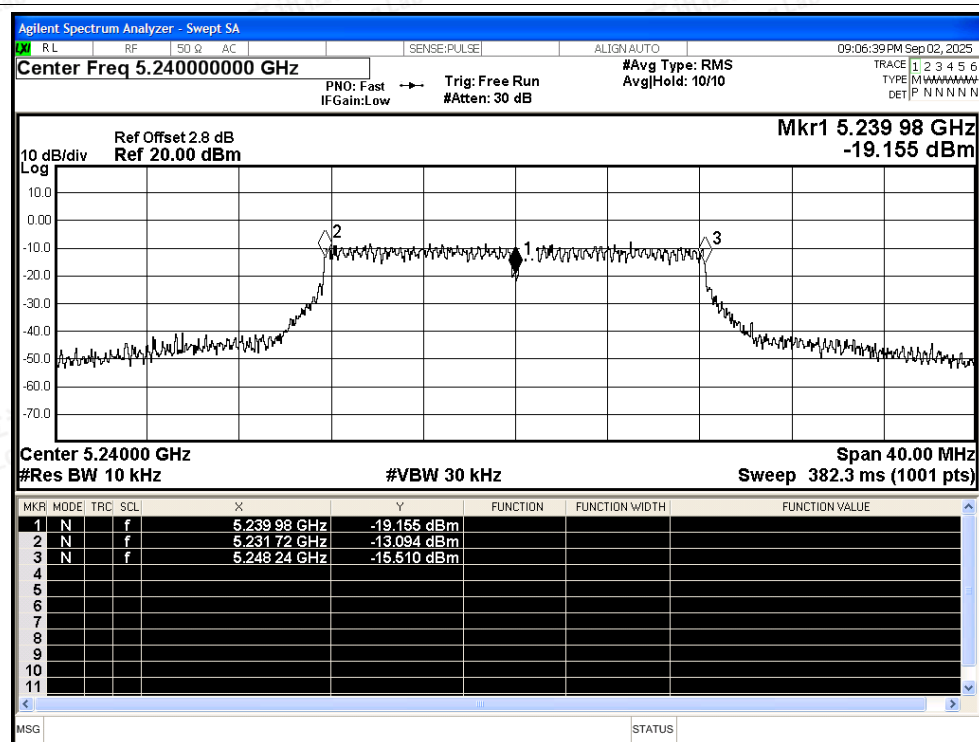

Freq. Stability NVNT n20 5180MHz Ant3

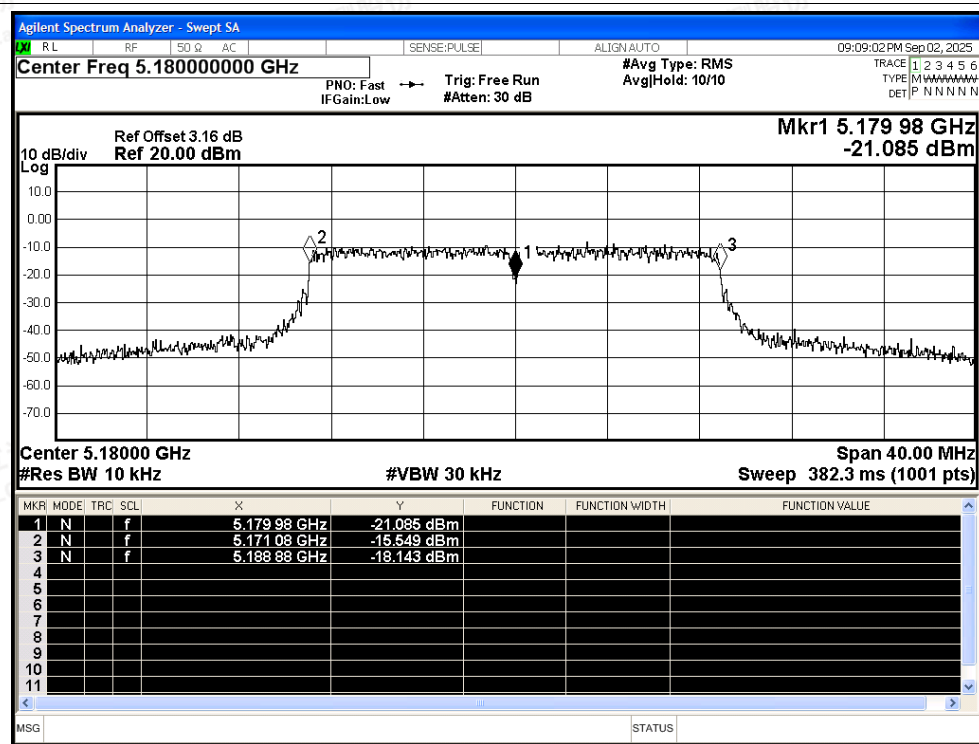

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant3

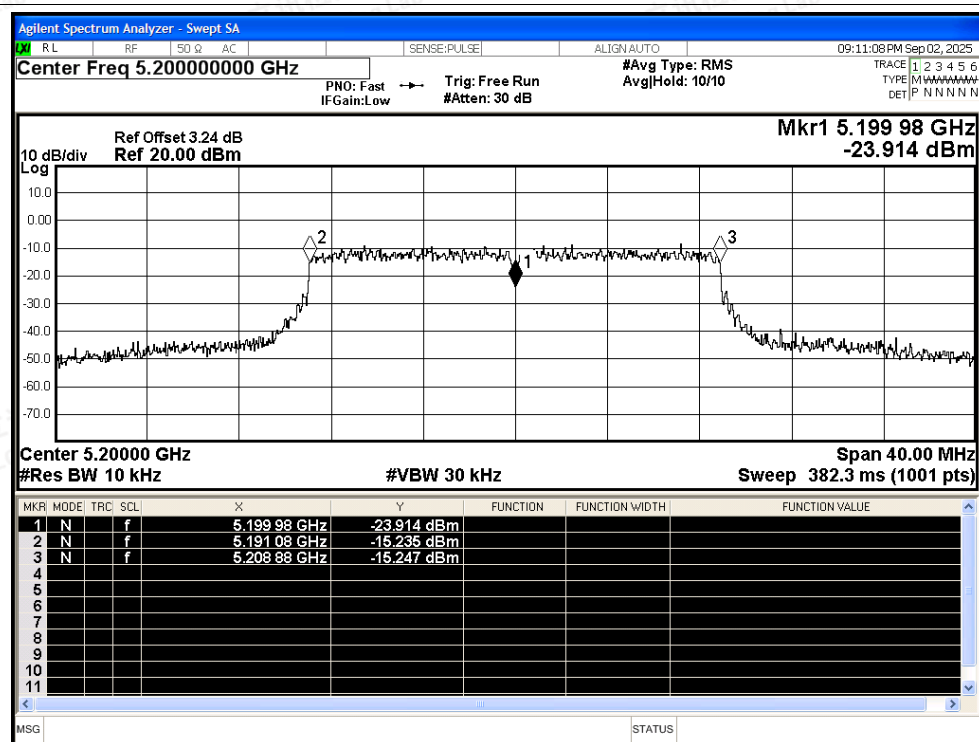

Freq. Stability NVNT n20 5240MHz Ant3

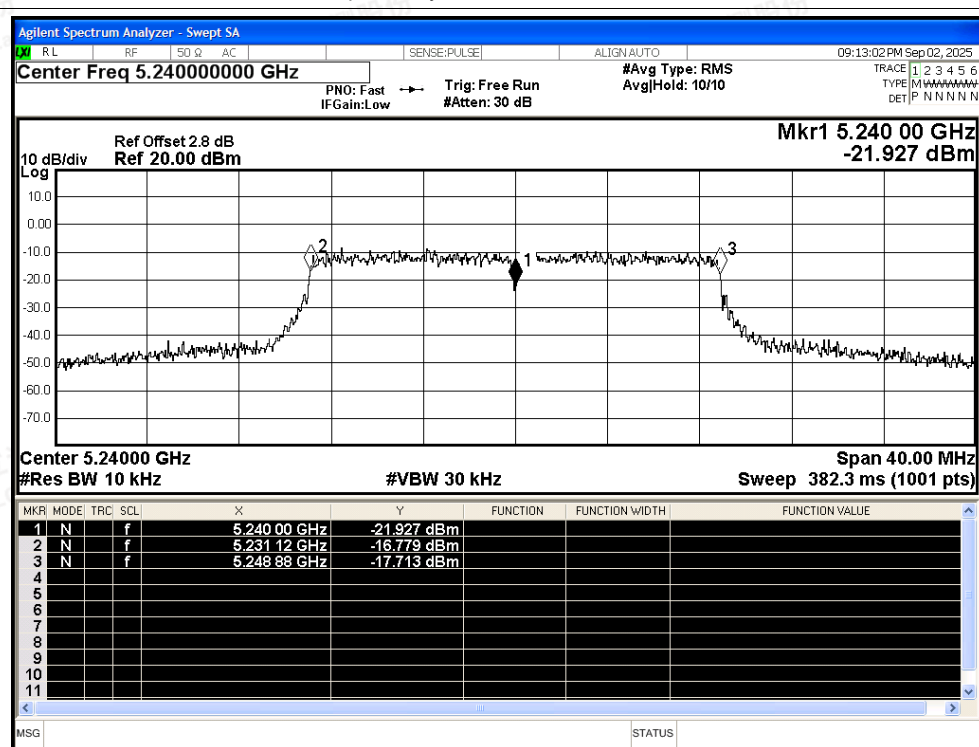

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant3

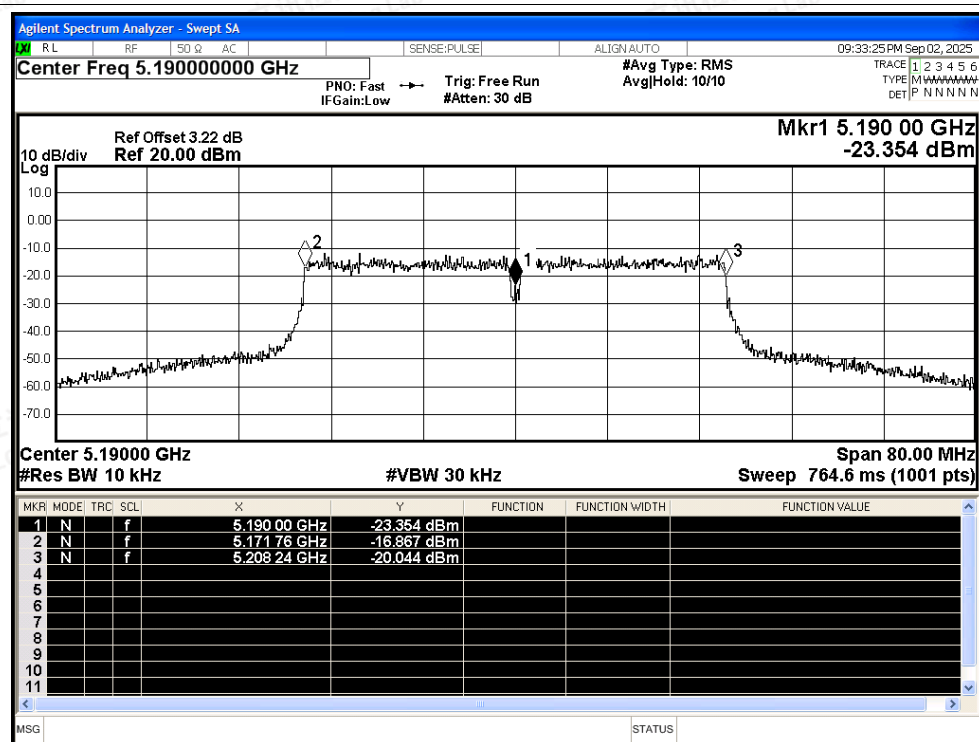


Freq. Stability NVNT n40 5230MHz Ant3

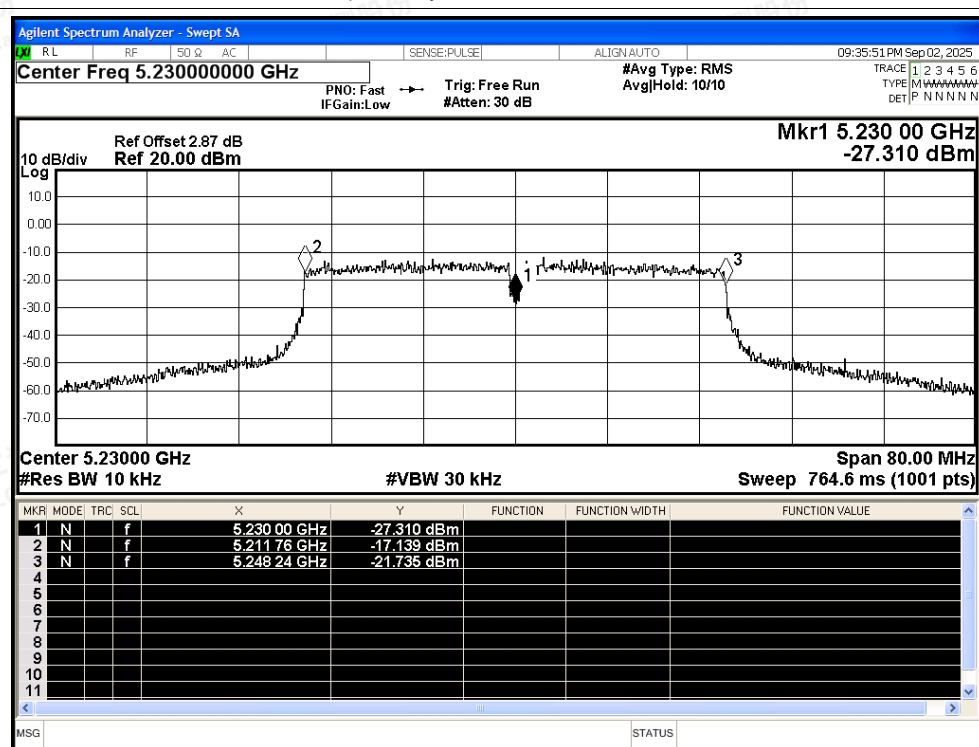




Freq. Stability NVNT ac20 5180MHz Ant3

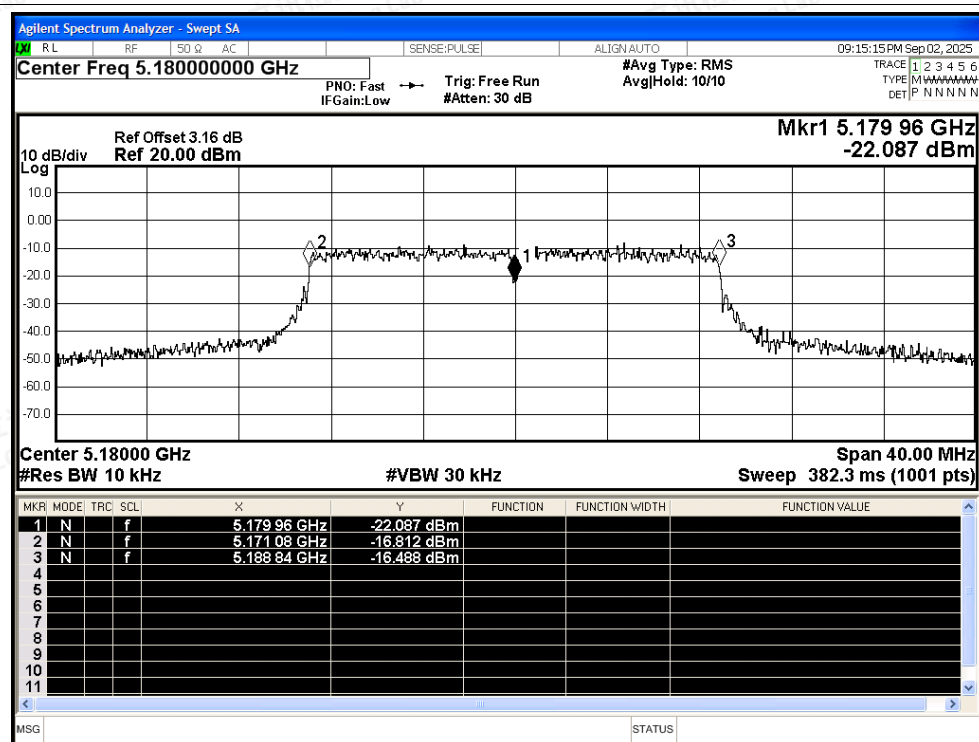


Freq. Stability NVNT ac20 5200MHz Ant3

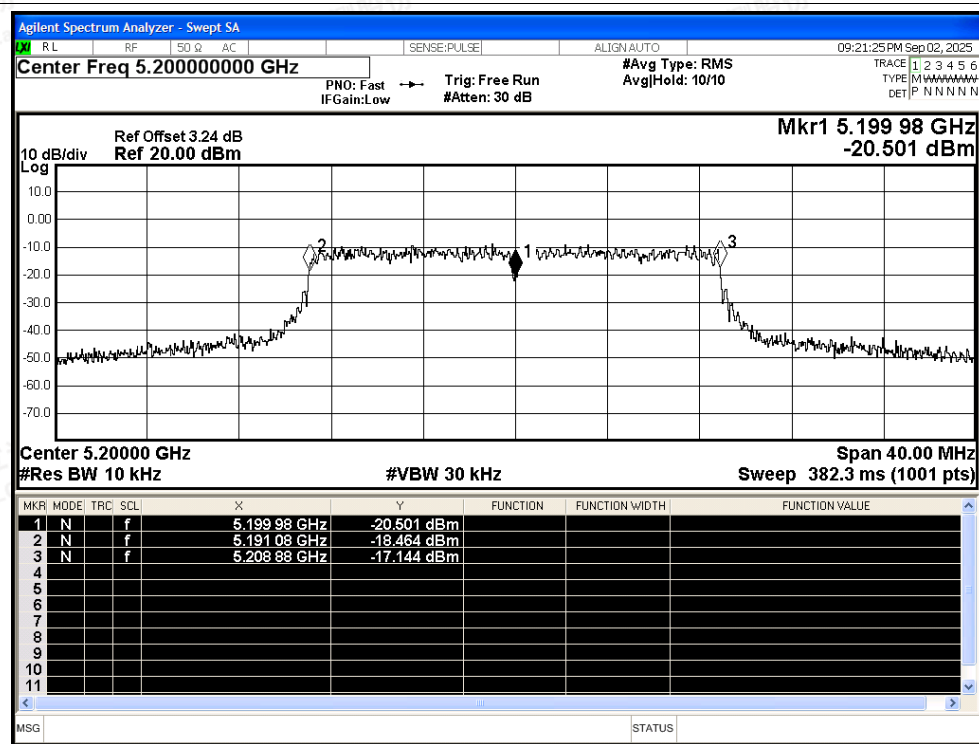




Freq. Stability NVNT ac20 5240MHz Ant3

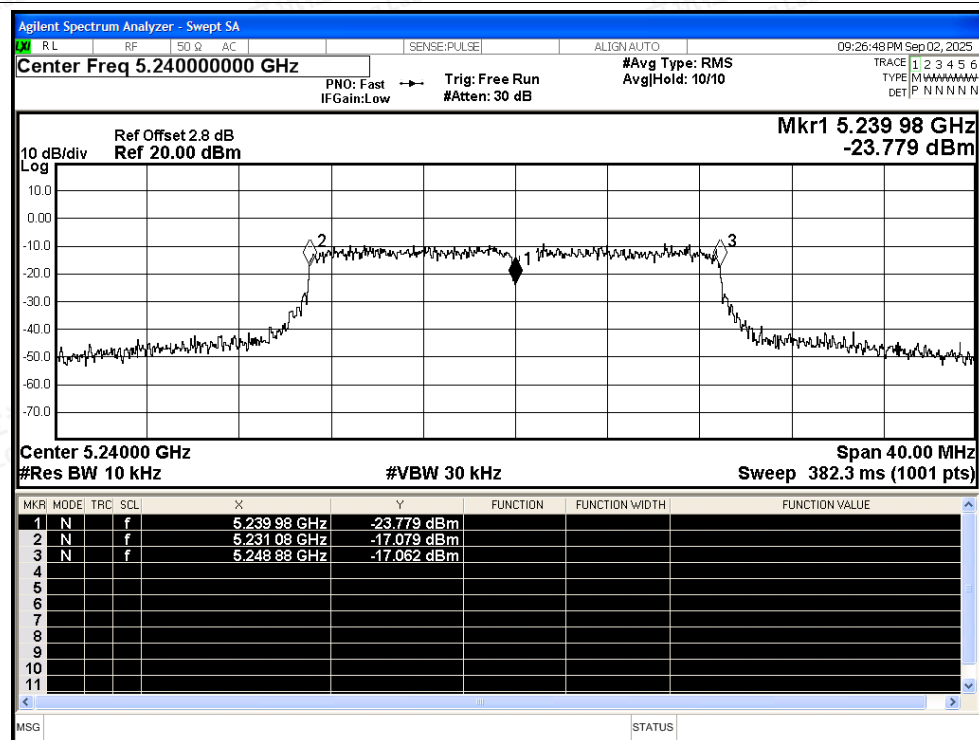

Freq. Stability NVNT ac40 5190MHz Ant3

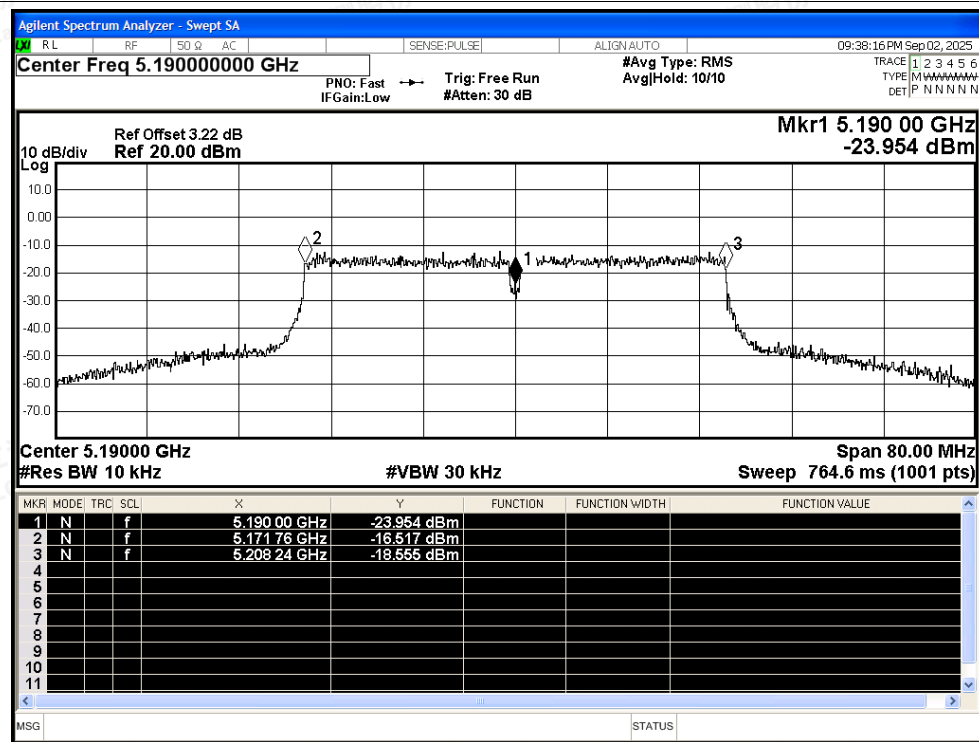

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant3

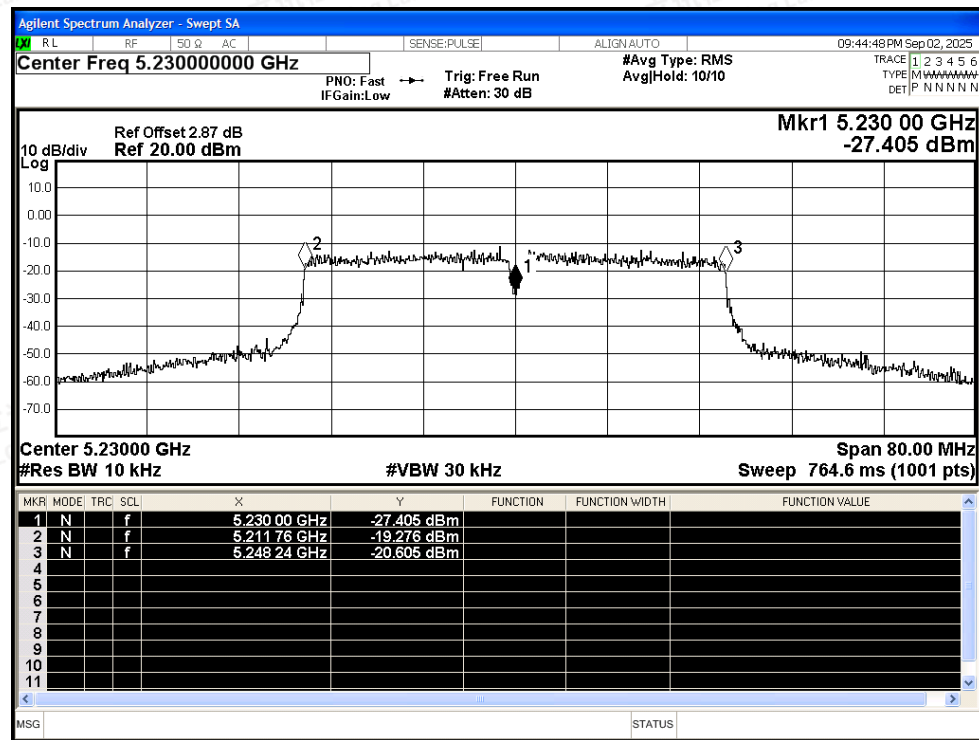


Freq. Stability NVNT ac80 5210MHz Ant3

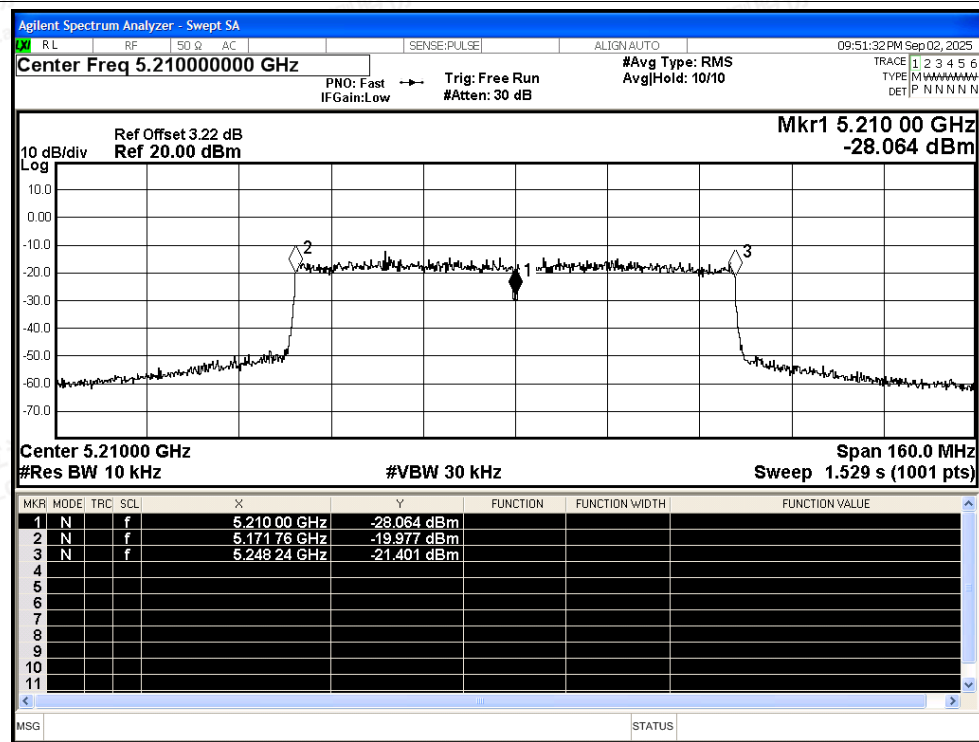




Freq. Stability NVNT ax20 5180MHz Ant3

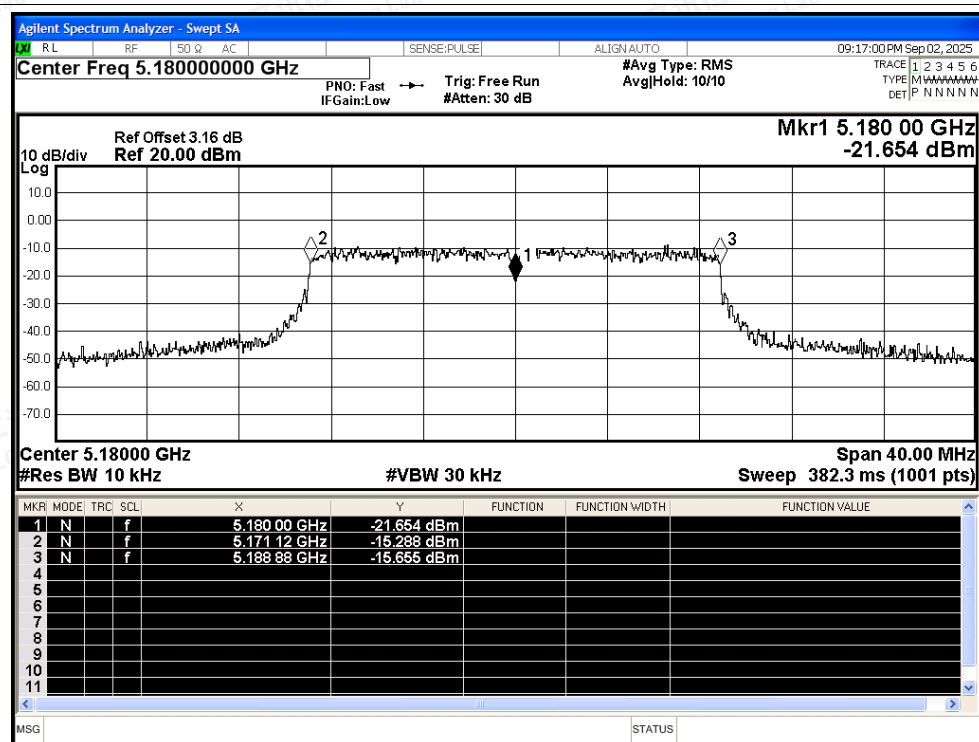


Freq. Stability NVNT ax20 5200MHz Ant3

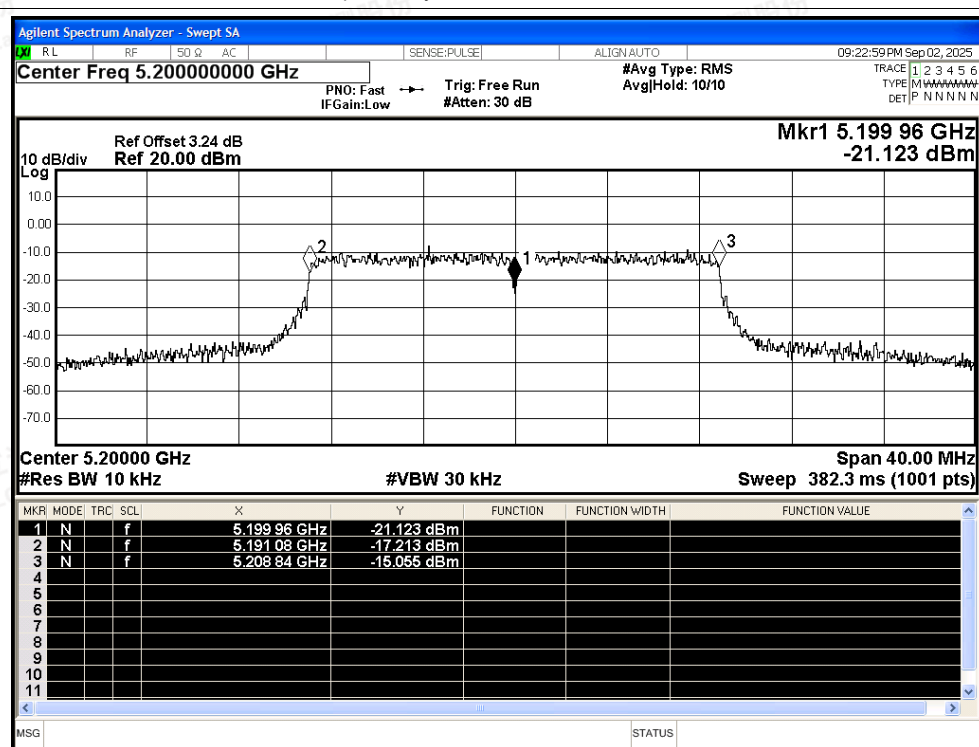




Freq. Stability NVNT ax20 5240MHz Ant3

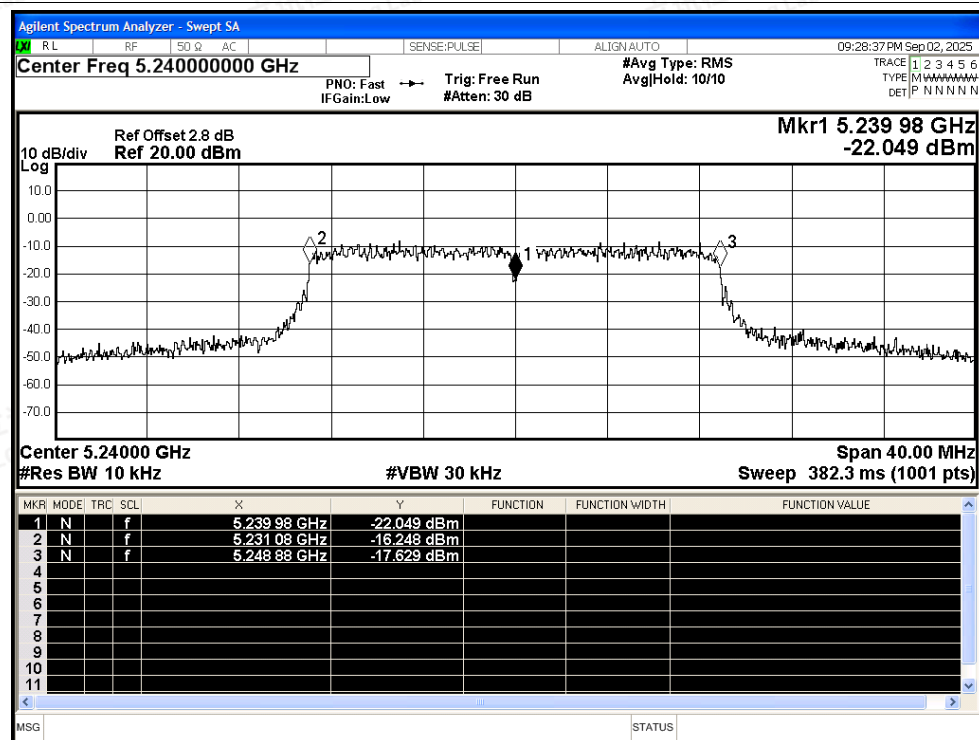


Freq. Stability NVNT ax40 5190MHz Ant3

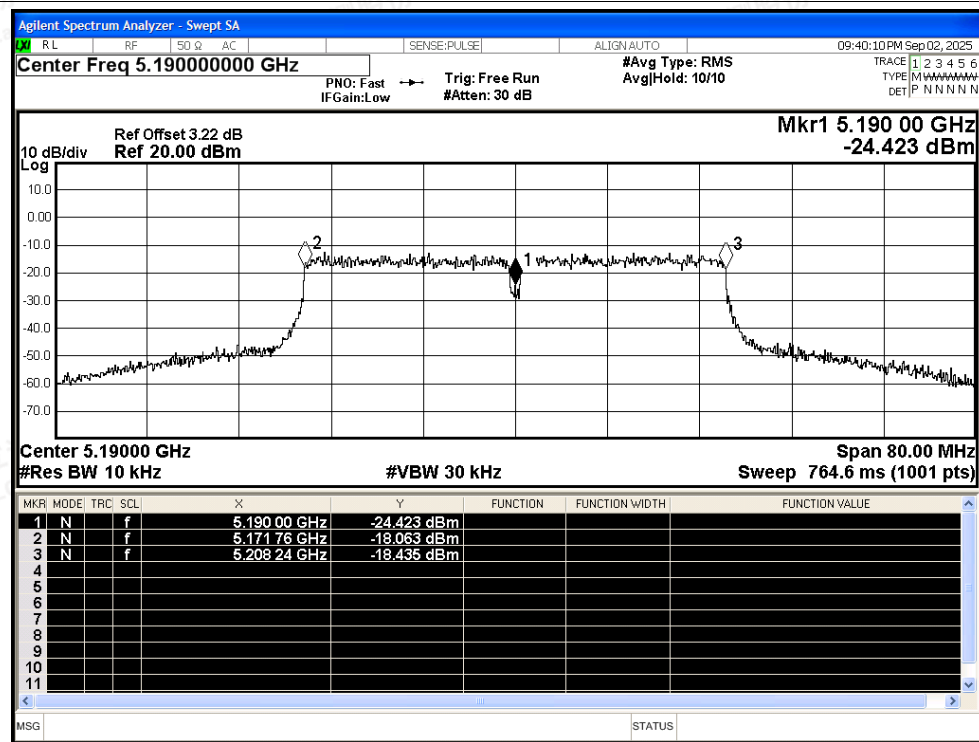




Freq. Stability NVNT ax40 5230MHz Ant3

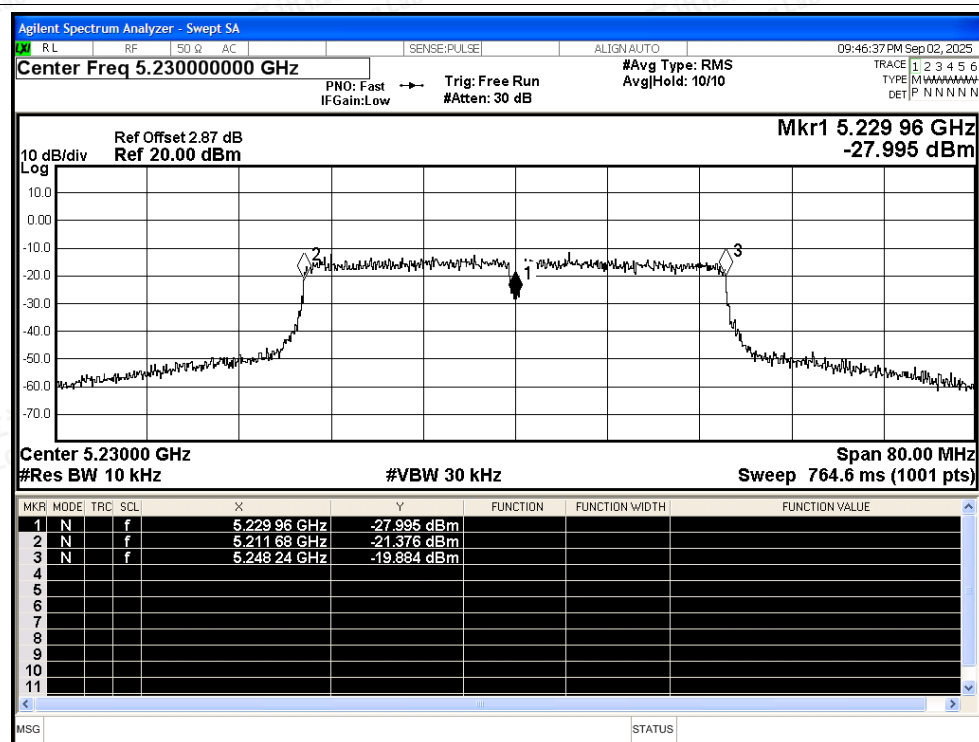


Freq. Stability NVNT ax80 5210MHz Ant3

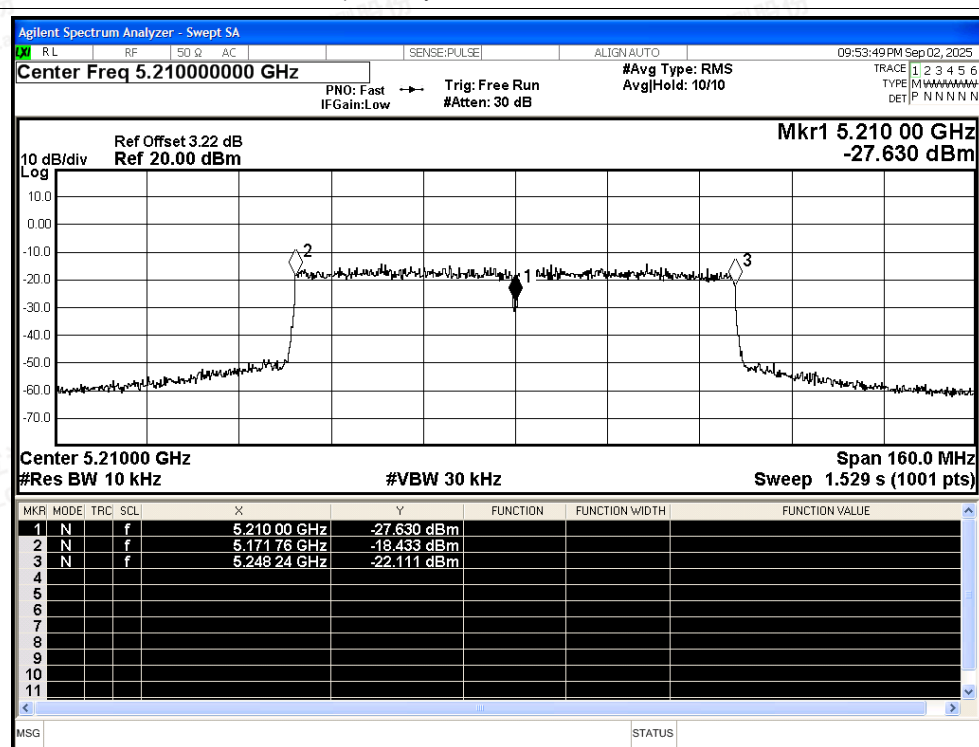




Freq. Stability NVNT be20 5180MHz Ant3

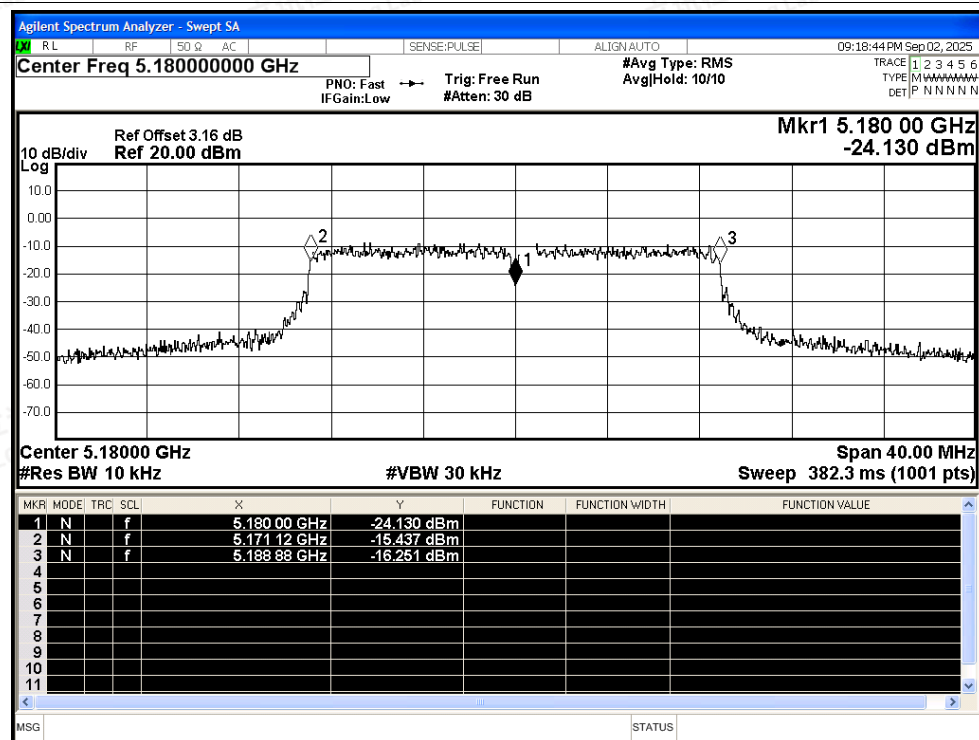

Freq. Stability NVNT be20 5200MHz Ant3

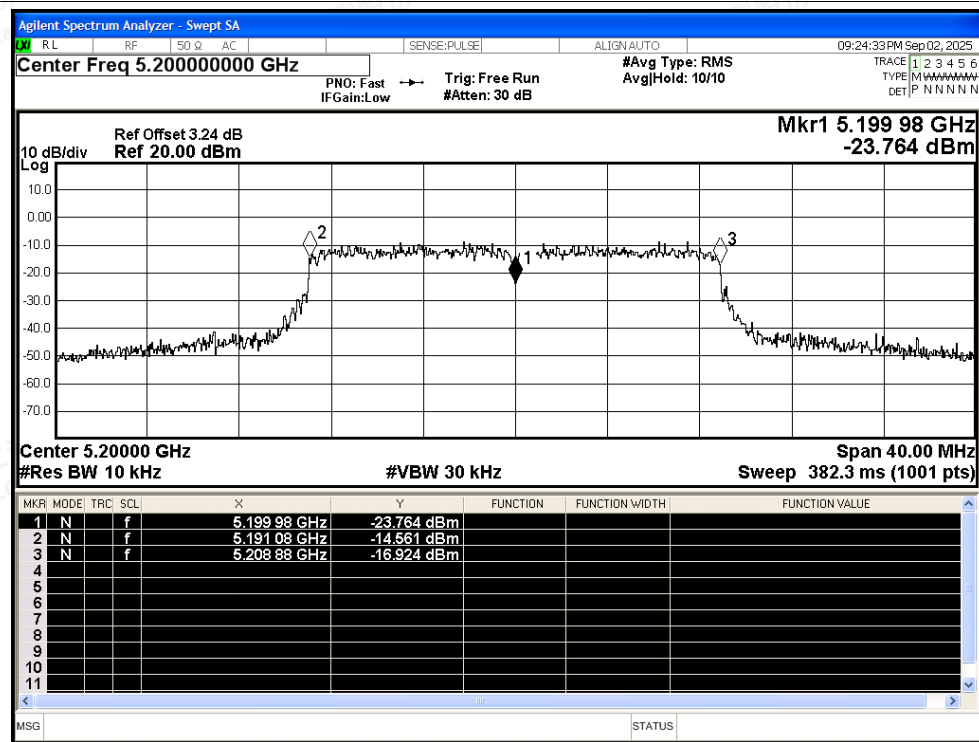

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be20 5240MHz Ant3

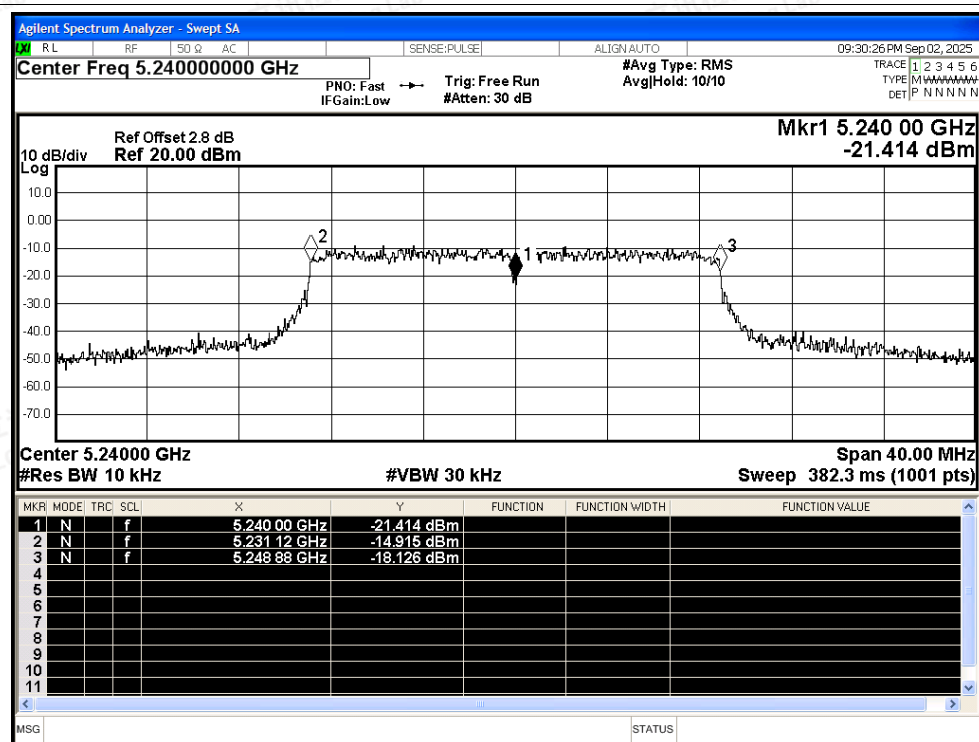


Freq. Stability NVNT be40 5190MHz Ant3

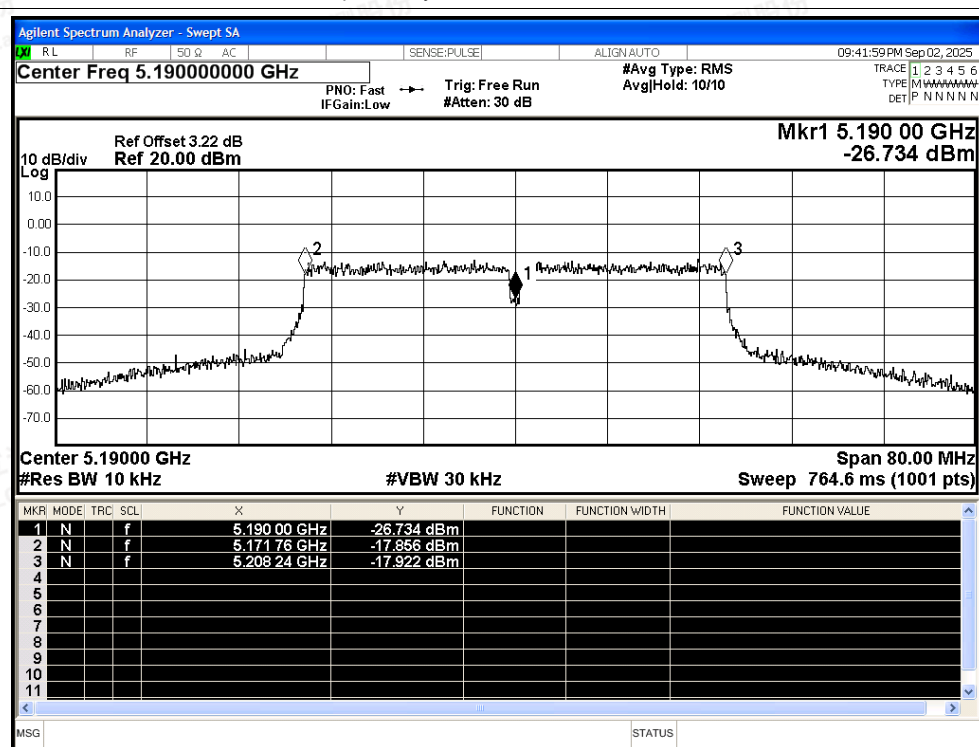




Freq. Stability NVNT be40 5230MHz Ant3

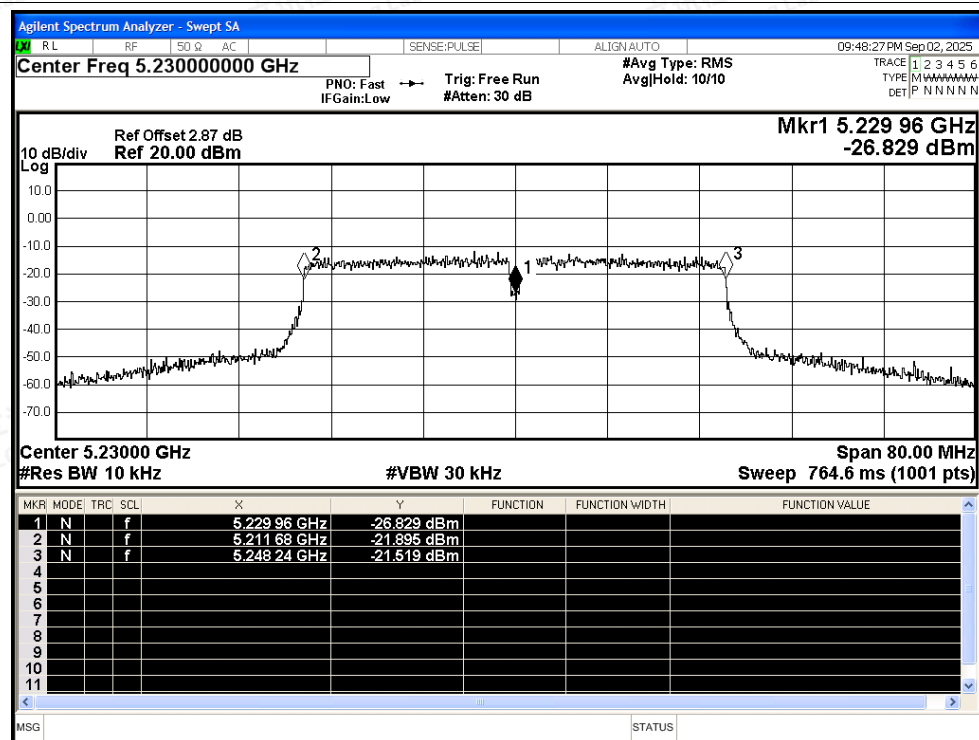


Freq. Stability NVNT be80 5210MHz Ant3

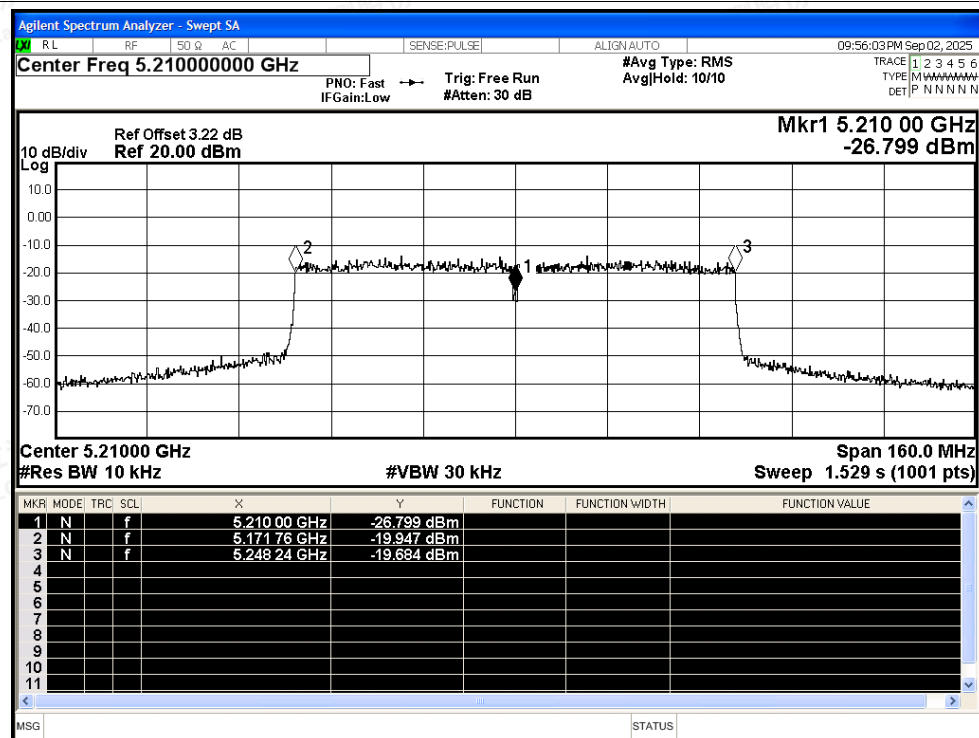



Freq. Stability NVNT ac160 5250MHz Ant3



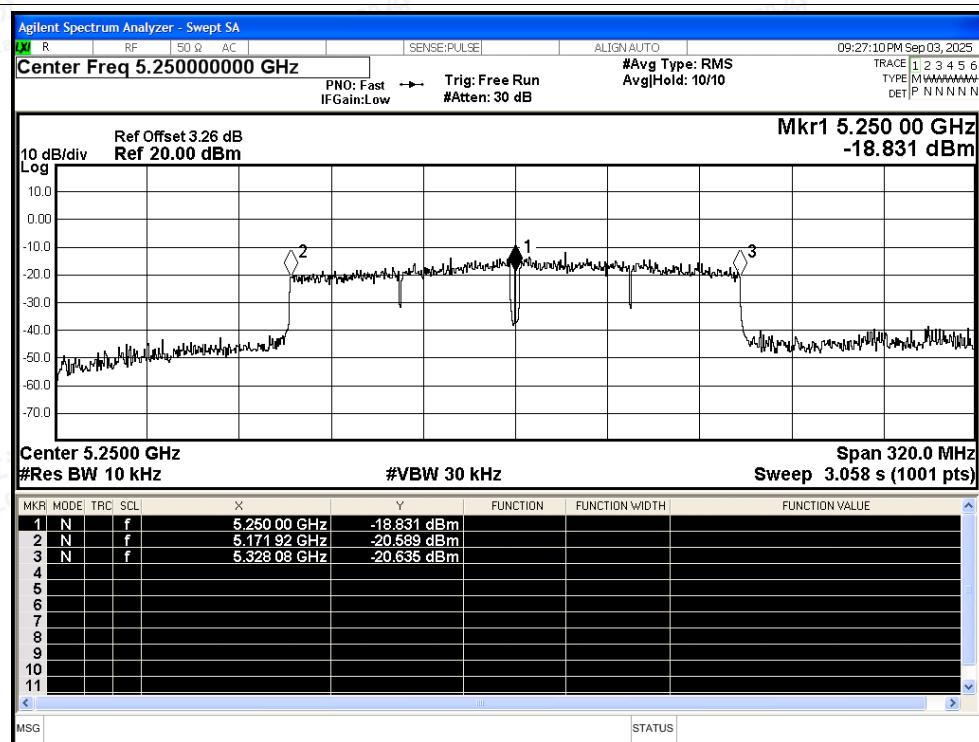

Freq. Stability NVNT ax160 5250MHz Ant3

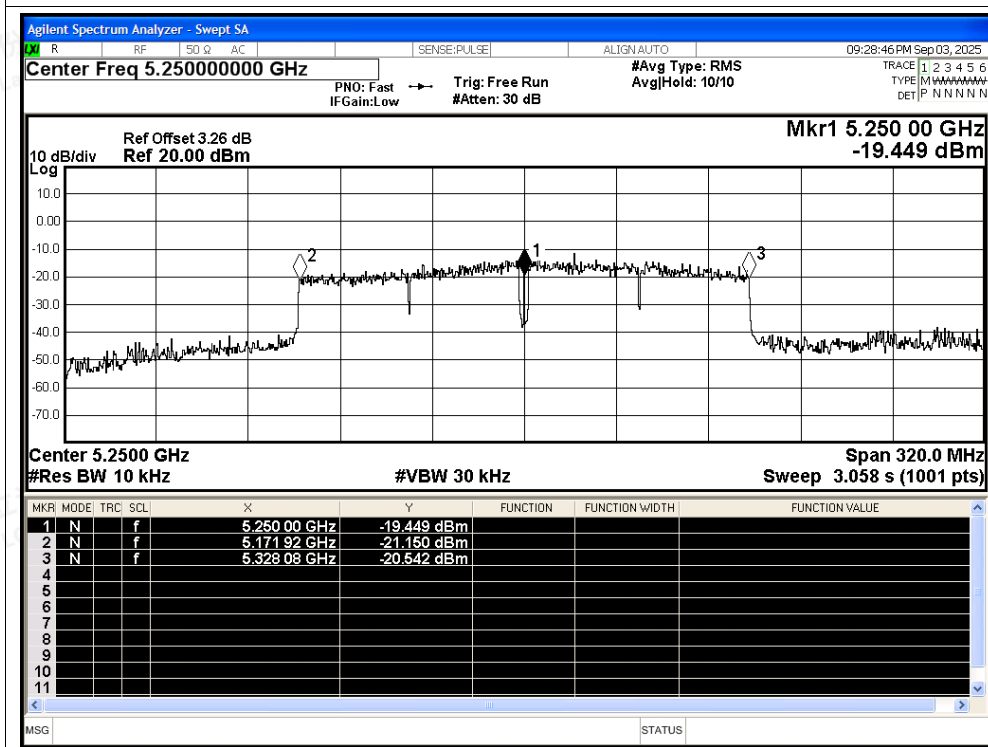

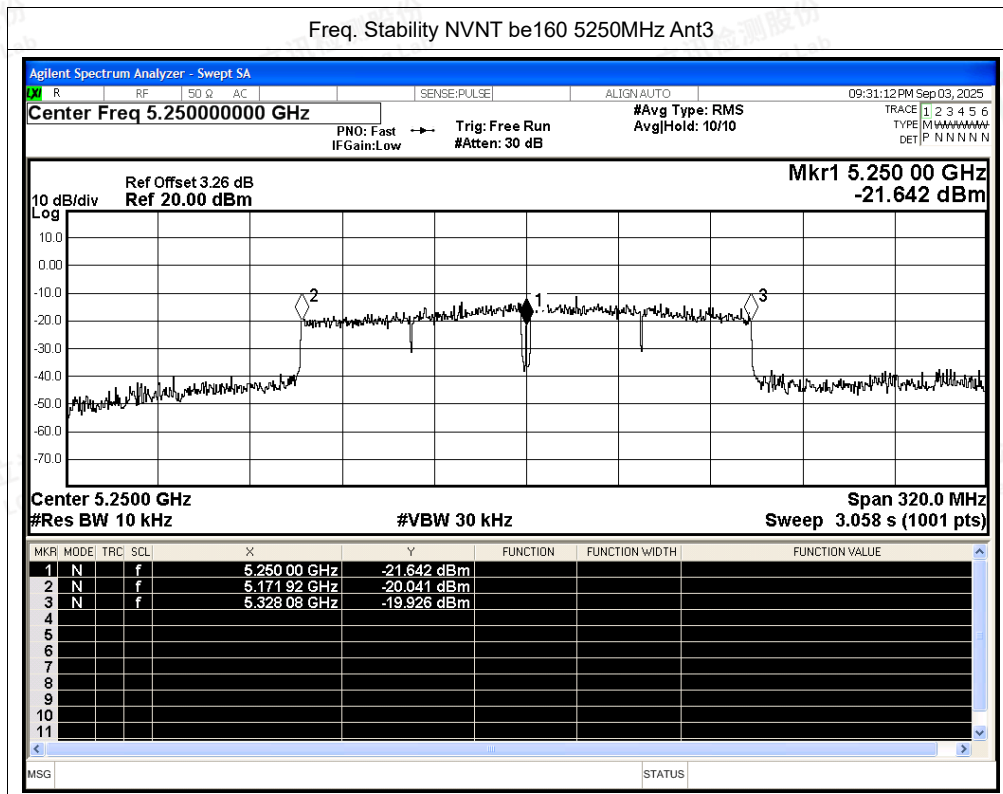




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant4	5180	0	0	25	Pass
NVNT	a	5200	Ant4	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant4	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant4	5180	0	0	25	Pass
NVNT	n20	5200	Ant4	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant4	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant4	5190	0	0	25	Pass
NVNT	n40	5230	Ant4	5230	0	0	25	Pass
NVNT	ac20	5180	Ant4	5180	0	0	25	Pass
NVNT	ac20	5200	Ant4	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant4	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant4	5190	0	0	25	Pass
NVNT	ac40	5230	Ant4	5230	0	0	25	Pass
NVNT	ac80	5210	Ant4	5210	0	0	25	Pass
NVNT	ax20	5180	Ant4	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant4	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant4	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant4	5190	0	0	25	Pass
NVNT	ax40	5230	Ant4	5230	0	0	25	Pass
NVNT	ax80	5210	Ant4	5210	0	0	25	Pass
NVNT	be20	5180	Ant4	5179.98	-20000	-3.86	25	Pass
NVNT	be20	5200	Ant4	5200	0	0	25	Pass
NVNT	be20	5240	Ant4	5239.98	-20000	-3.82	25	Pass
NVNT	be40	5190	Ant4	5190	0	0	25	Pass
NVNT	be40	5230	Ant4	5230	0	0	25	Pass
NVNT	be80	5210	Ant4	5210	0	0	25	Pass
NVNT	ac160	5250	Ant4	5250	0	0	25	Pass
NVNT	ax160	5250	Ant4	5250	0	0	25	Pass
NVNT	be160	5250	Ant4	5250	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant4

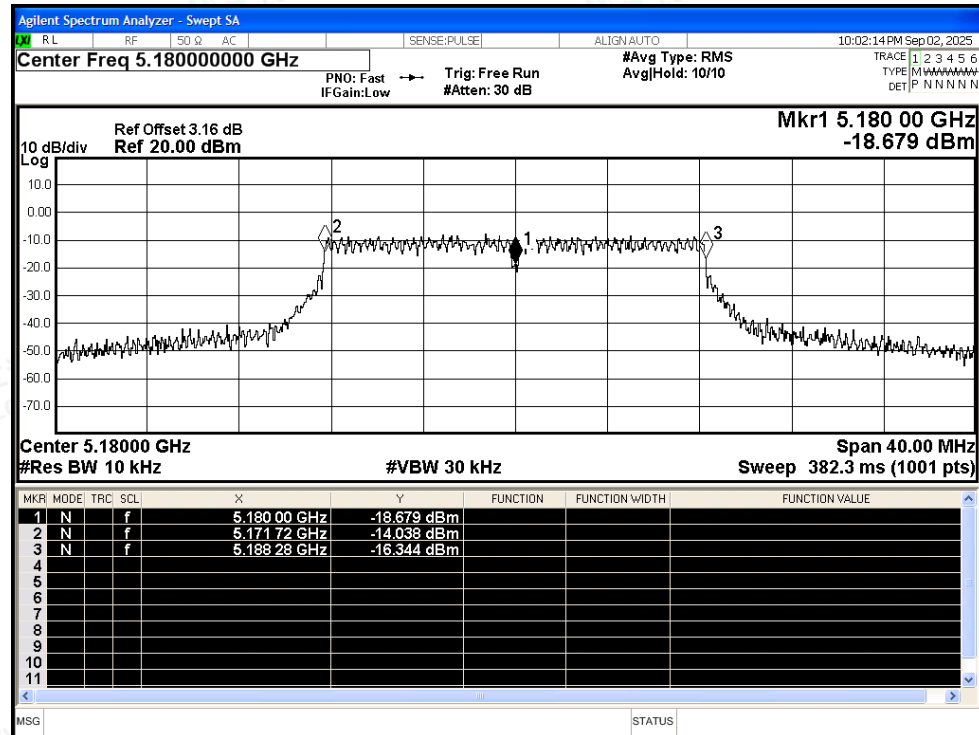


Freq. Stability NVNT a 5200MHz Ant4

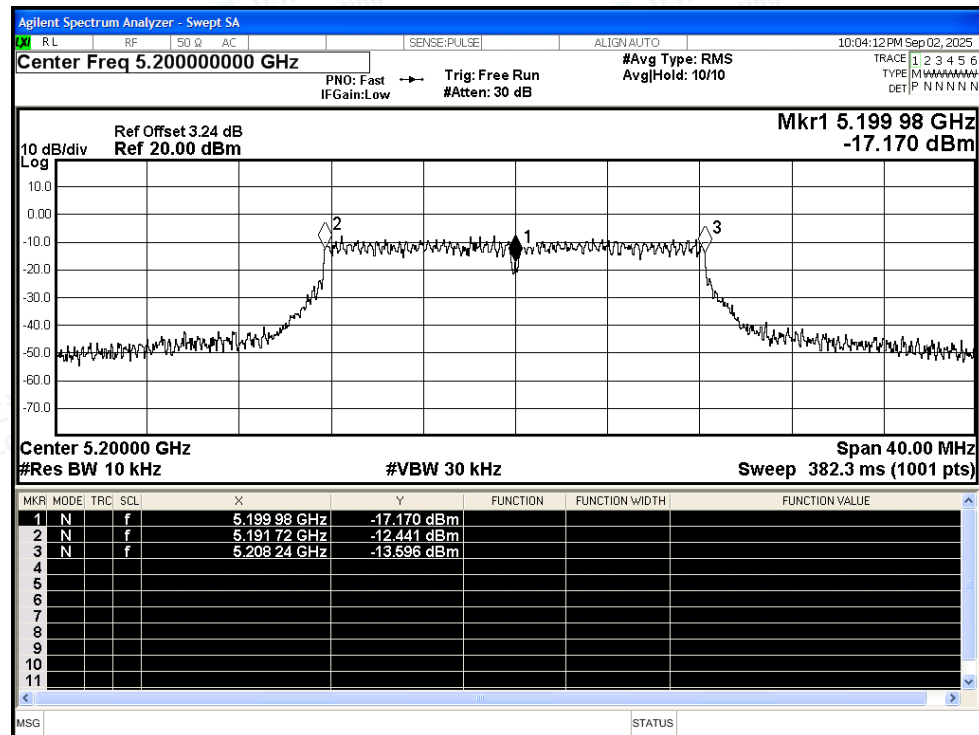




Freq. Stability NVNT a 5240MHz Ant4

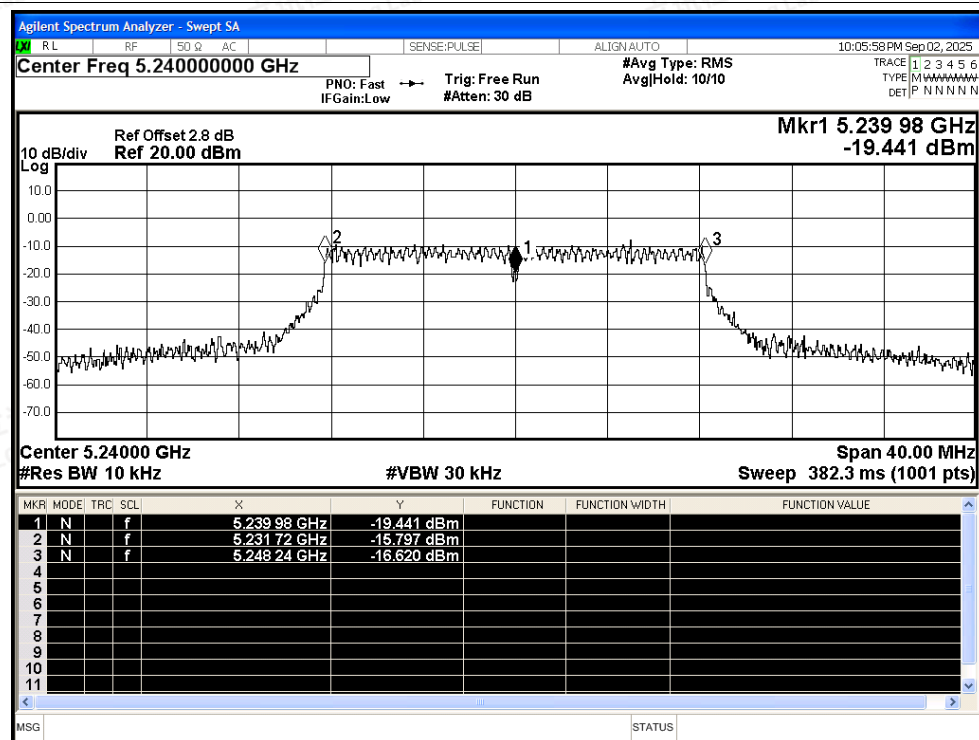

Freq. Stability NVNT n20 5180MHz Ant4

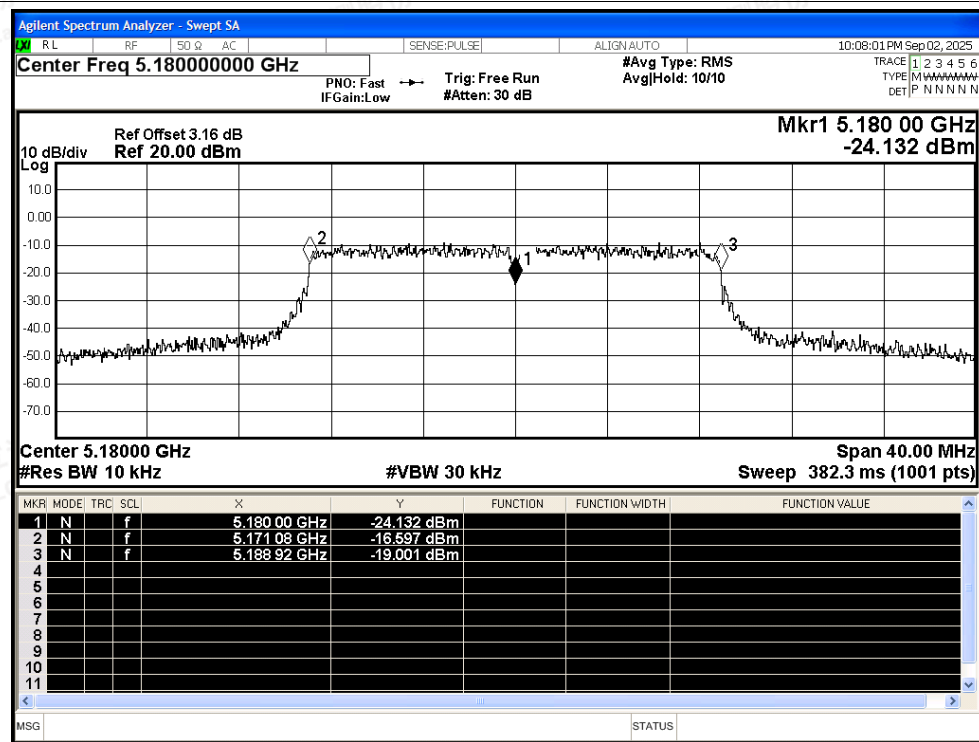

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant4

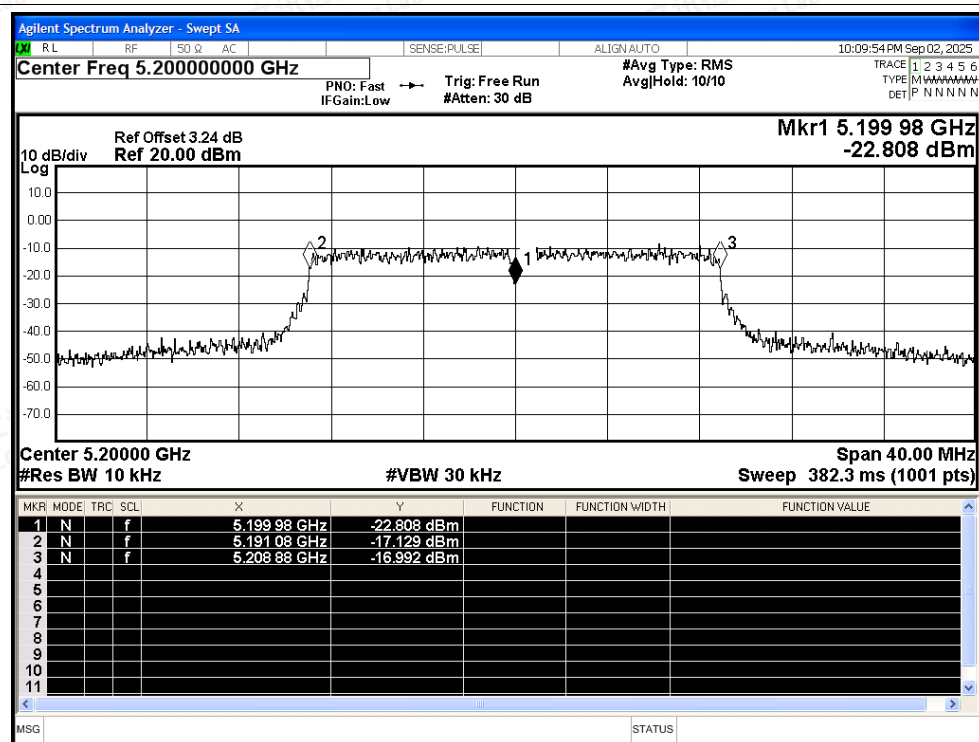

Freq. Stability NVNT n20 5240MHz Ant4

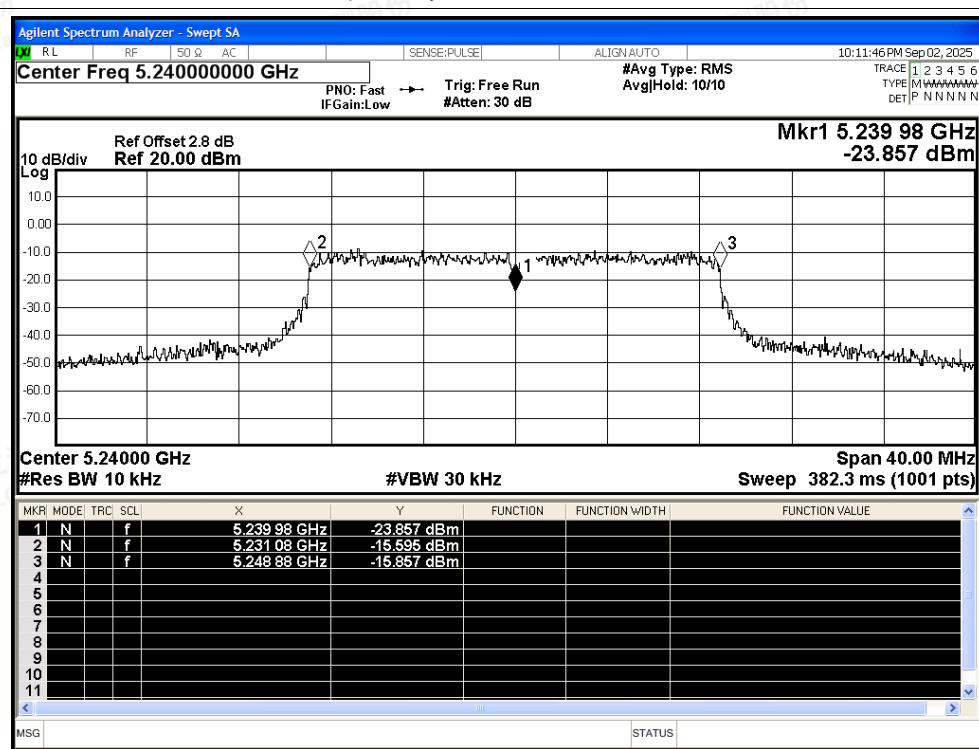

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant4

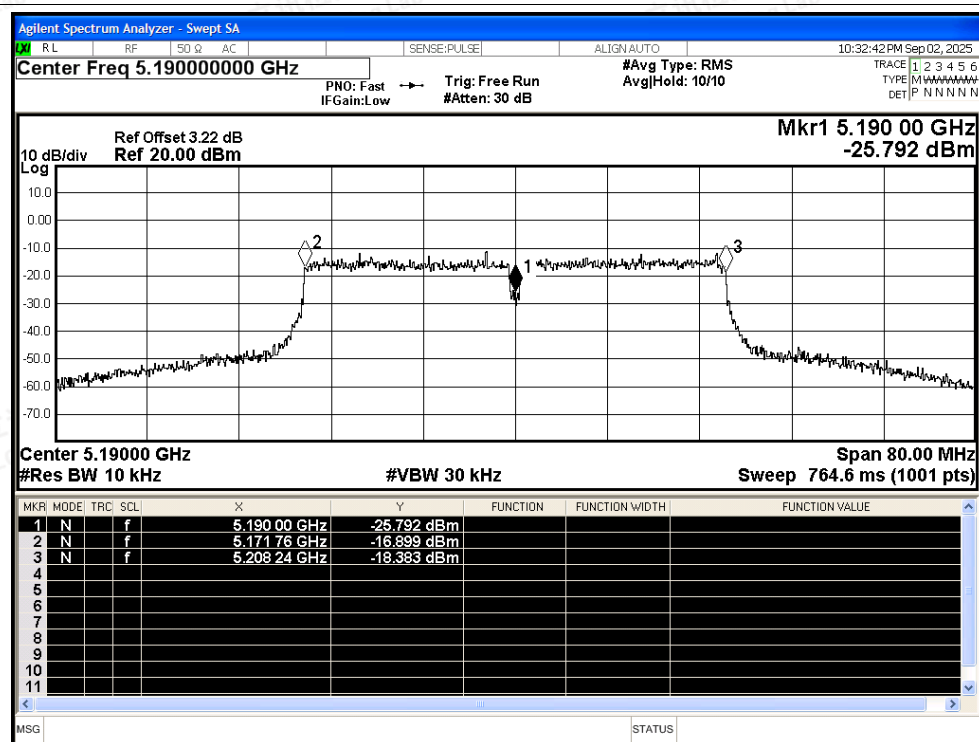

Freq. Stability NVNT n40 5230MHz Ant4

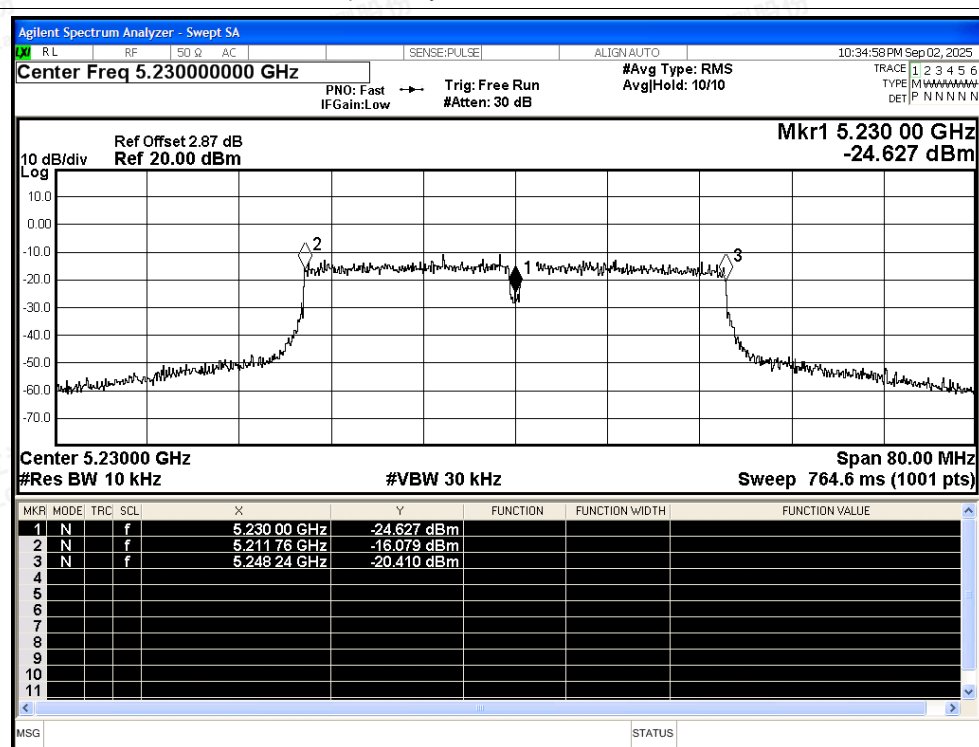

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant4

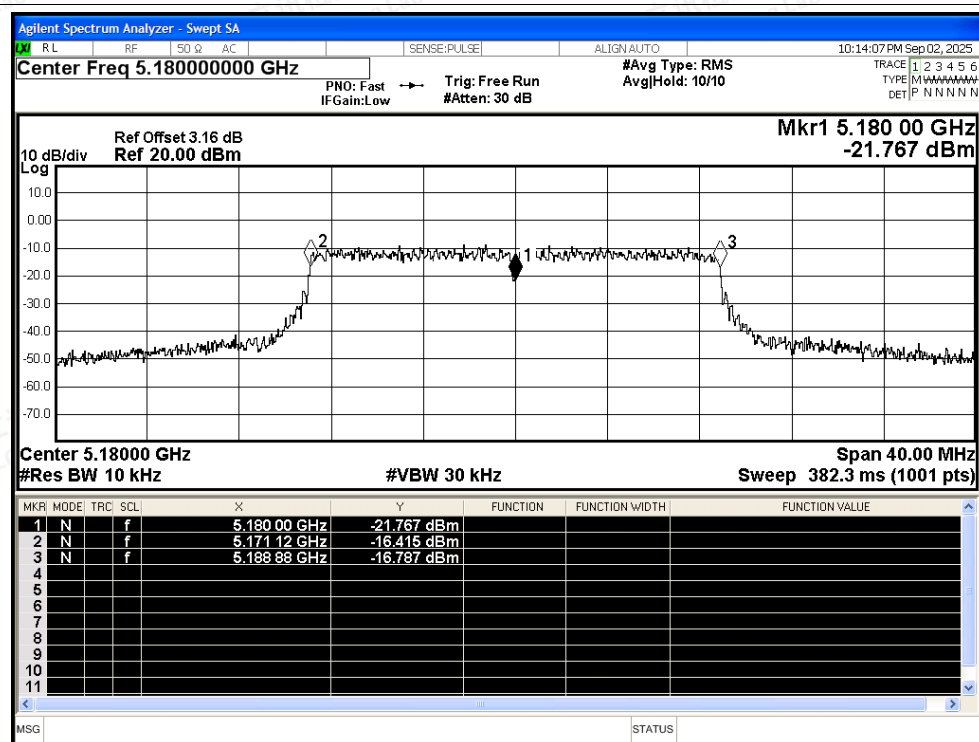

Freq. Stability NVNT ac20 5200MHz Ant4

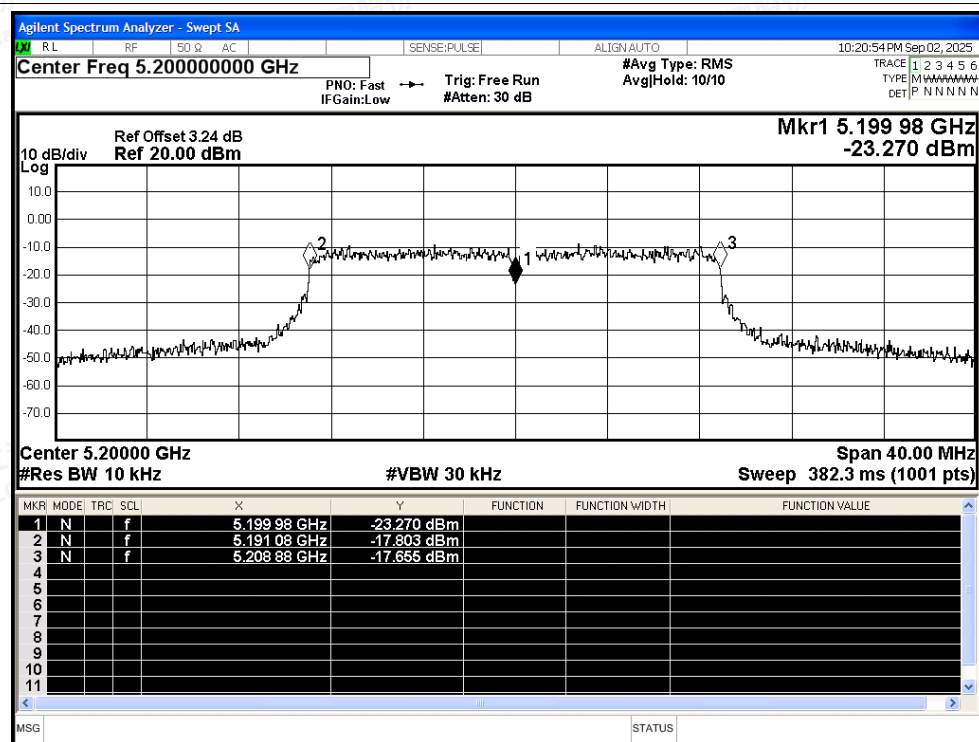

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant4

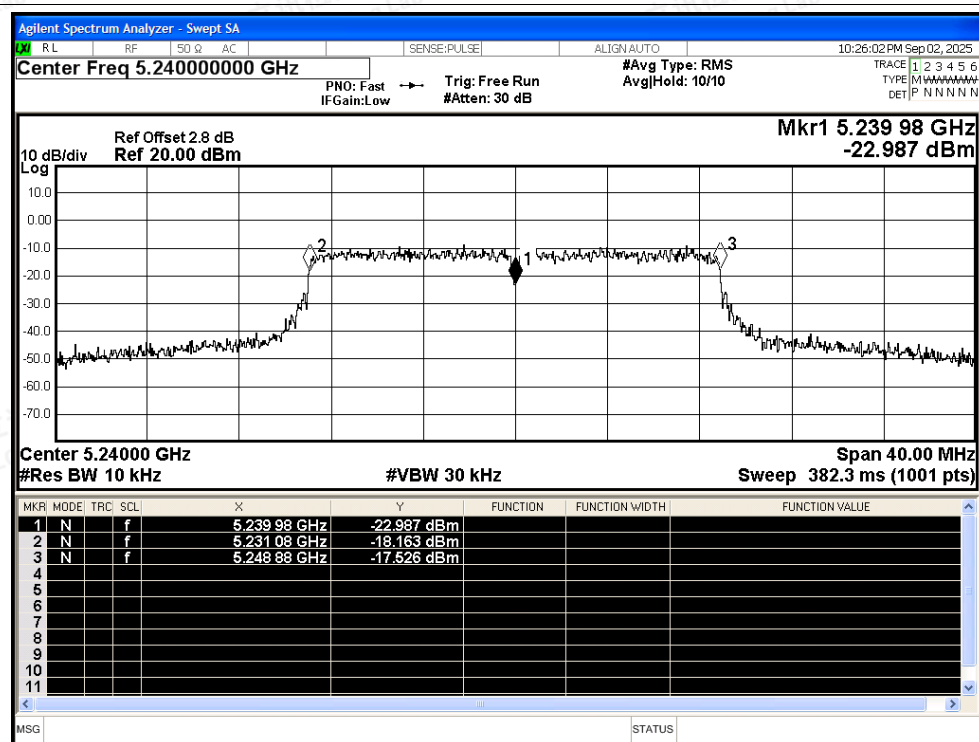


Freq. Stability NVNT ac40 5190MHz Ant4

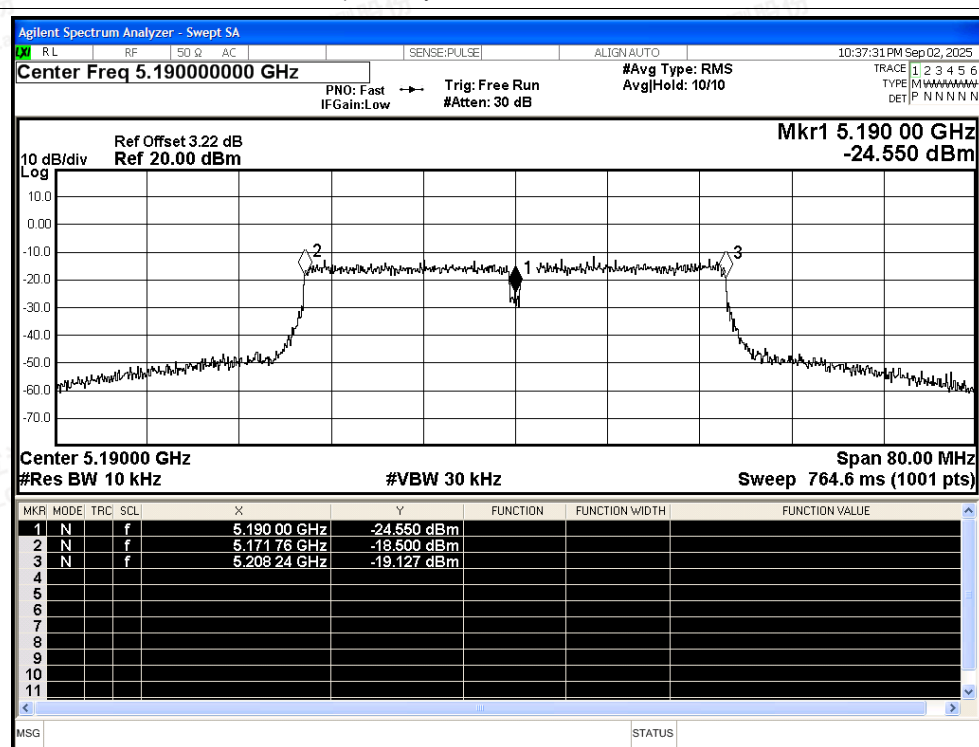




Freq. Stability NVNT ac40 5230MHz Ant4

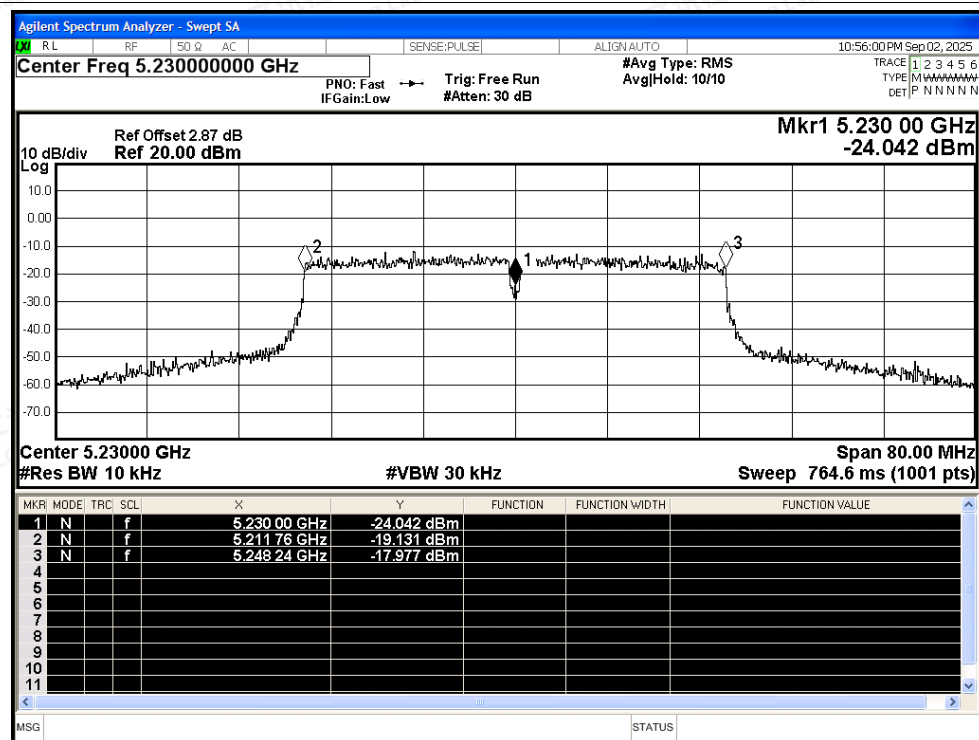

Freq. Stability NVNT ac80 5210MHz Ant4

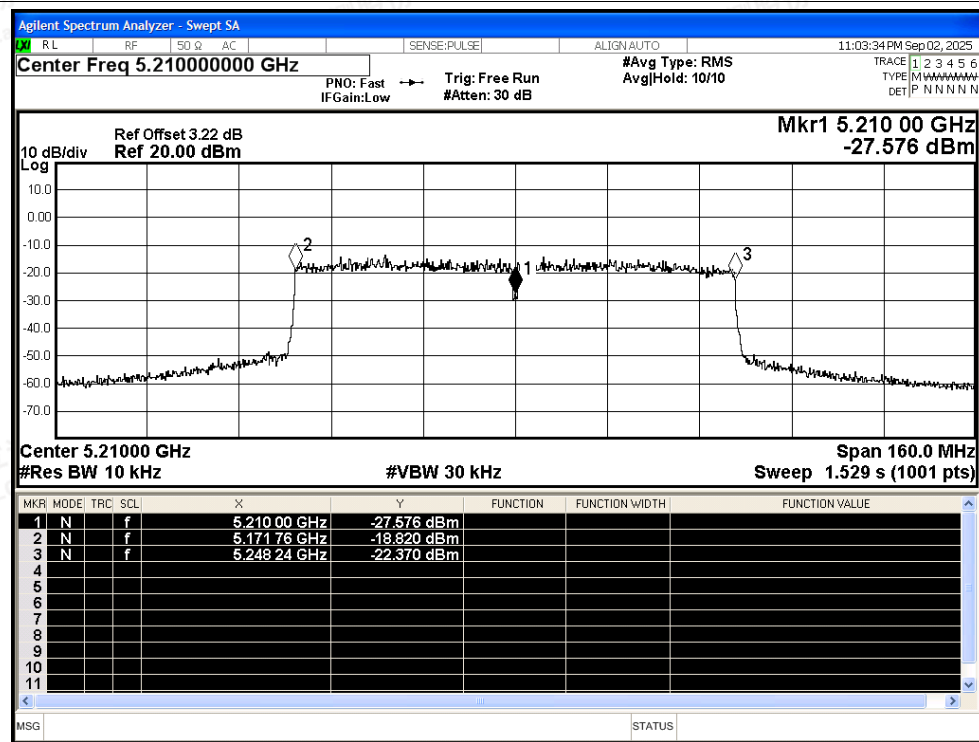

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant4

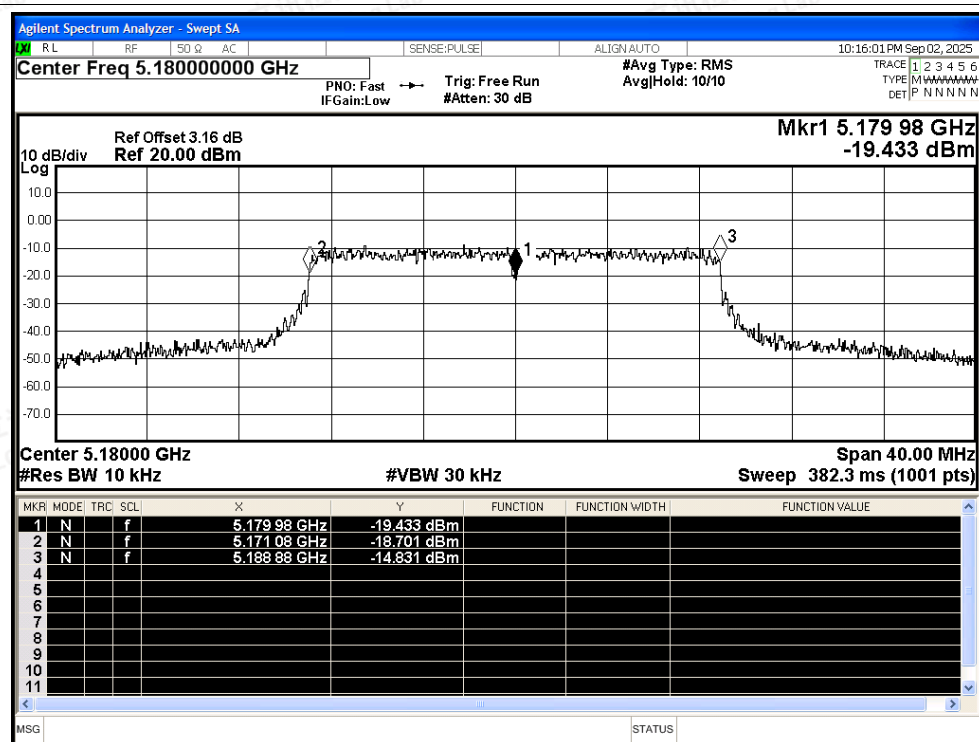

Freq. Stability NVNT ax20 5200MHz Ant4

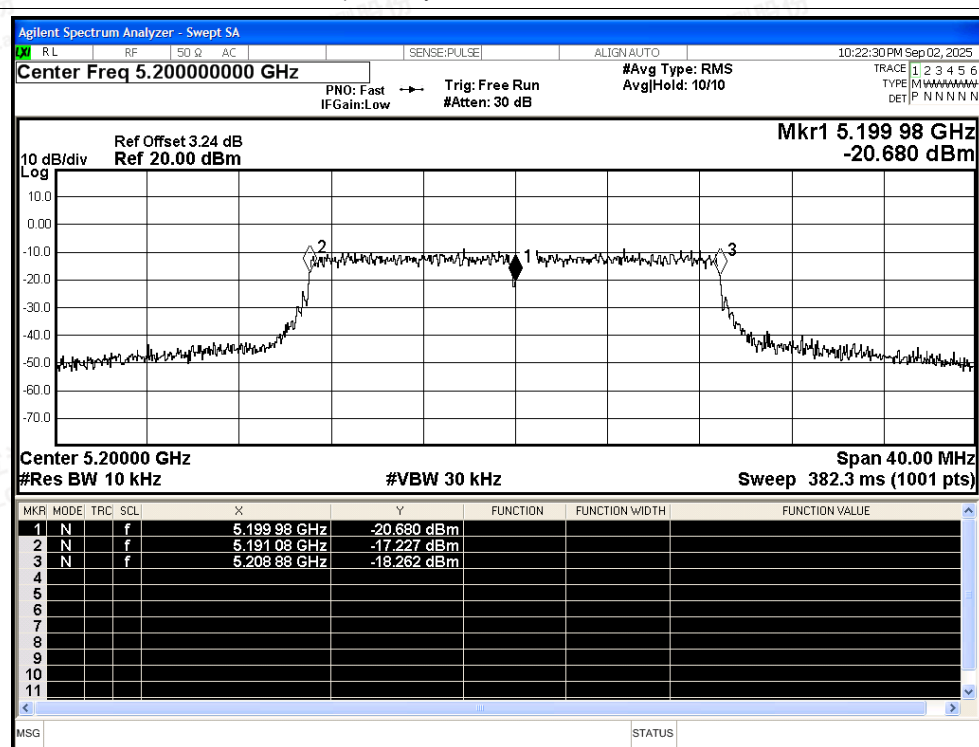

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant4

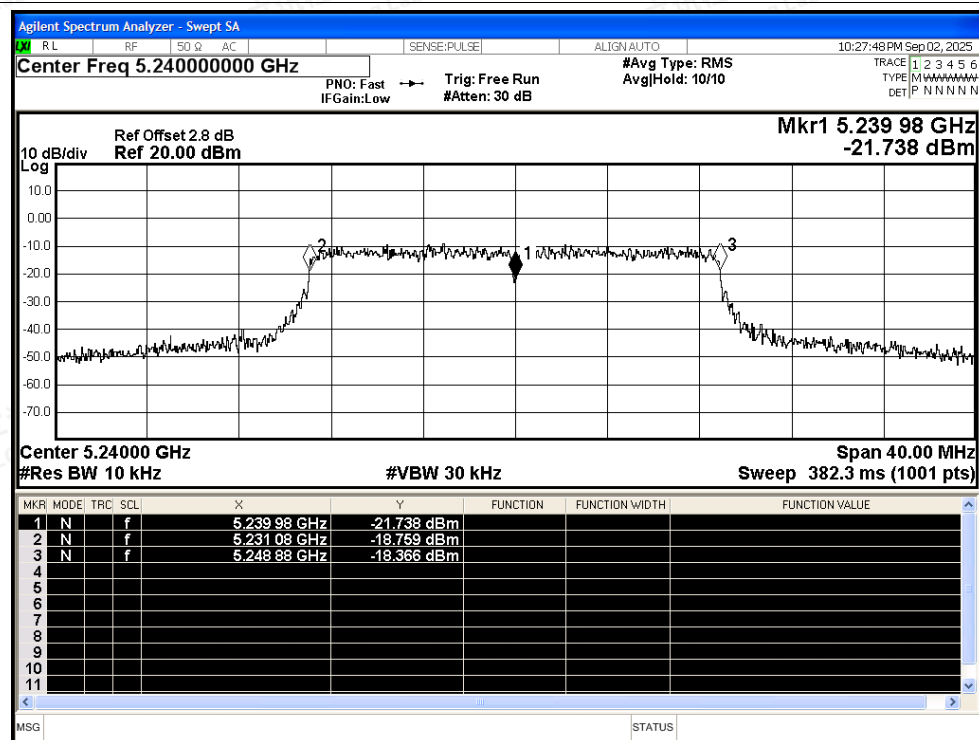

Freq. Stability NVNT ax40 5190MHz Ant4

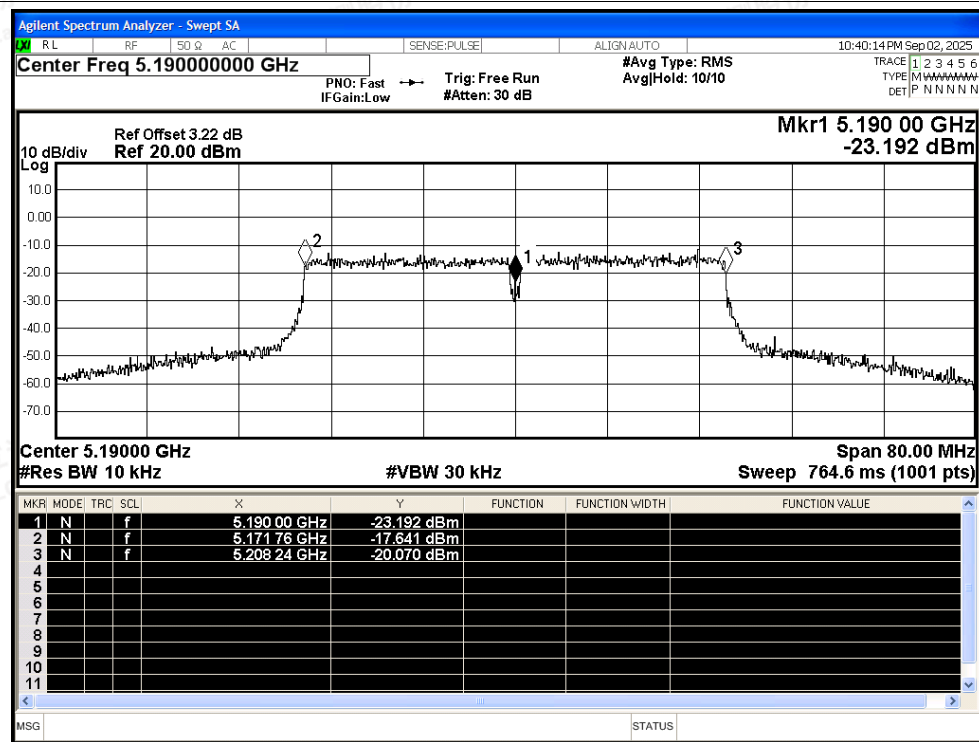

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant4

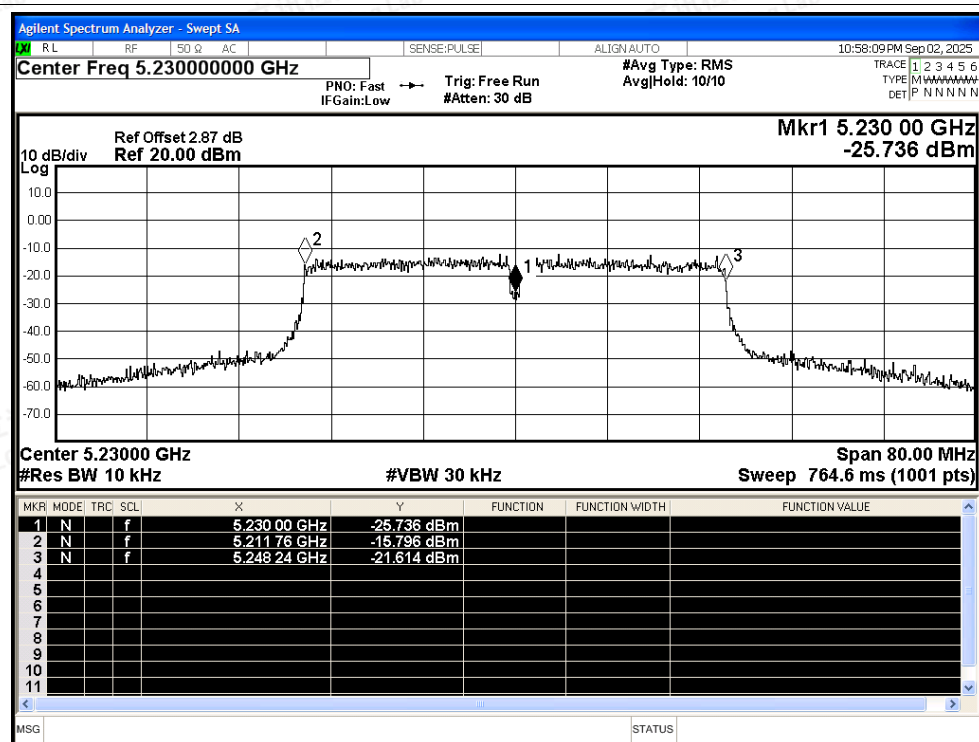


Freq. Stability NVNT ax80 5210MHz Ant4

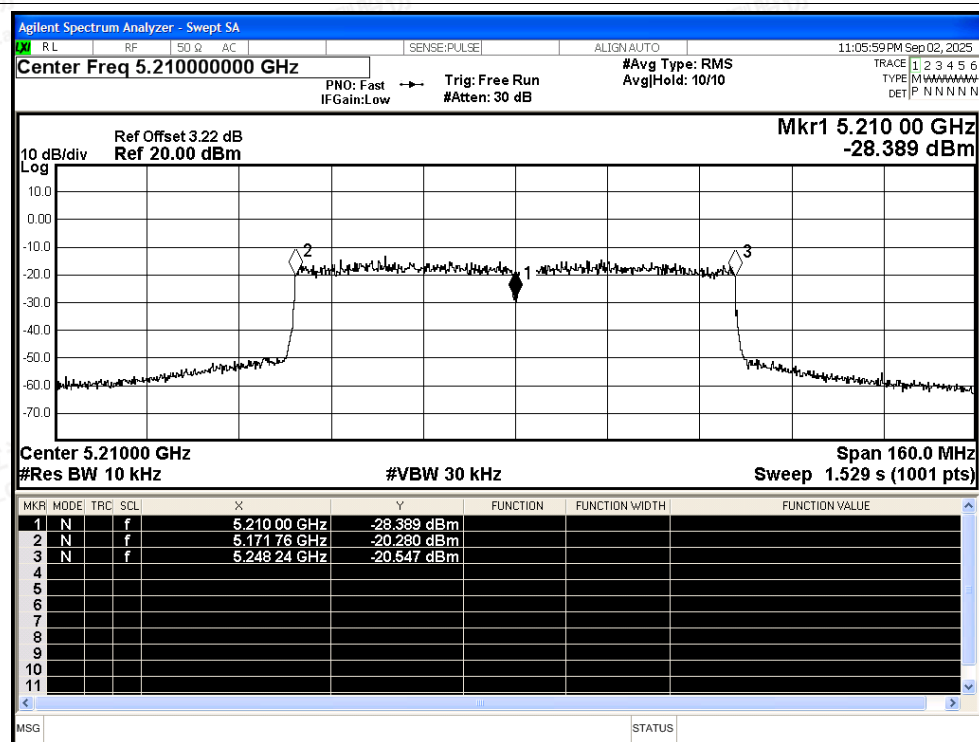




Freq. Stability NVNT be20 5180MHz Ant4

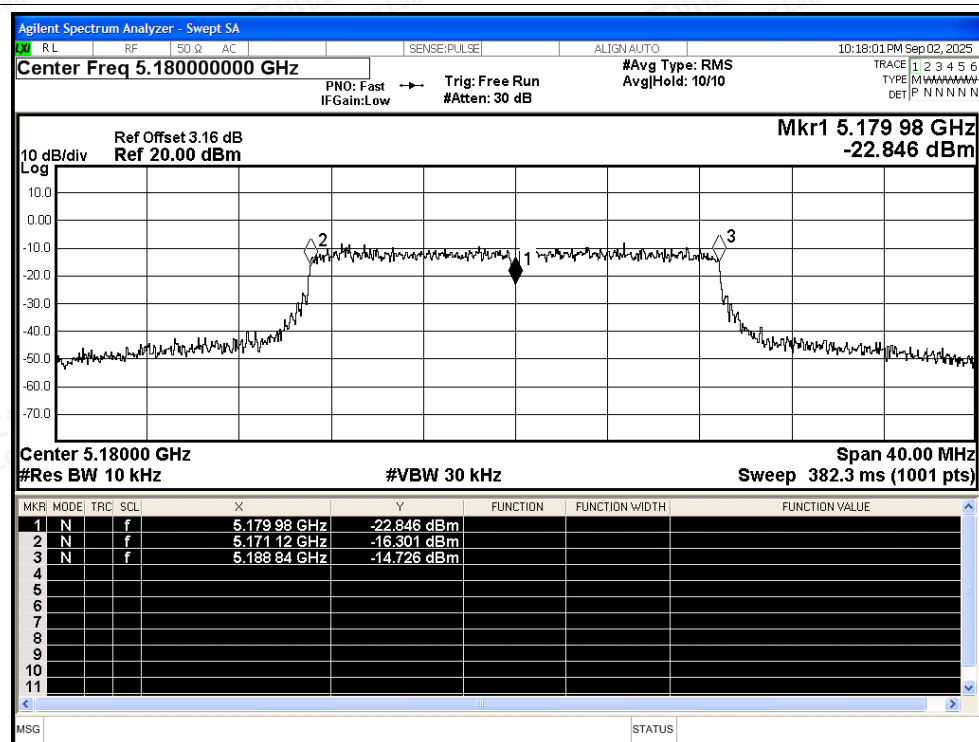


Freq. Stability NVNT be20 5200MHz Ant4

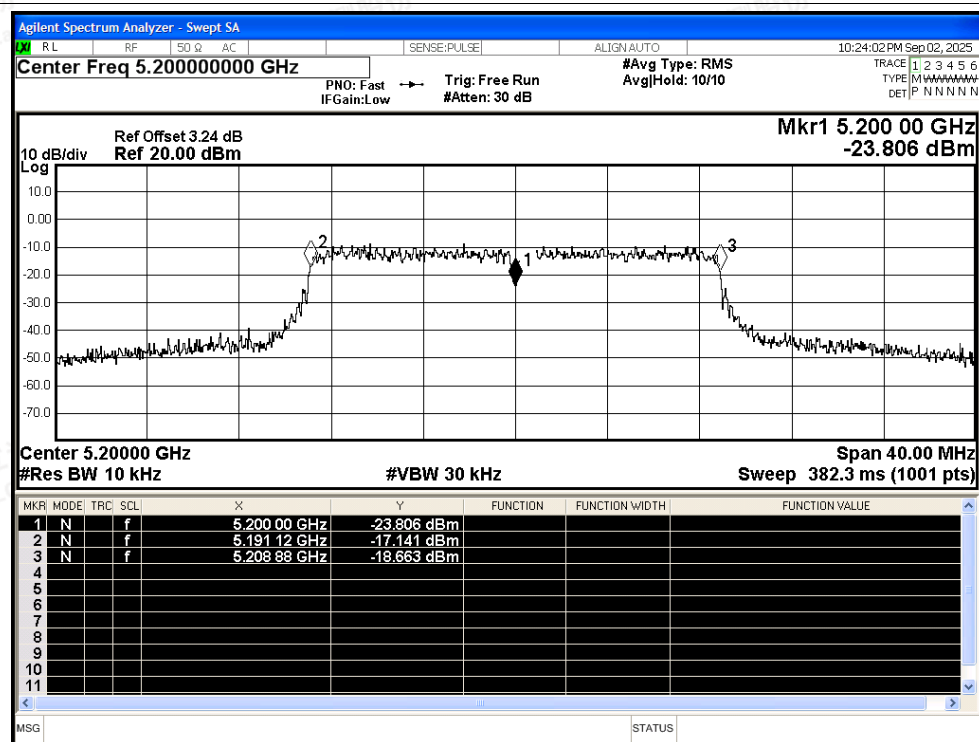




Freq. Stability NVNT be20 5240MHz Ant4

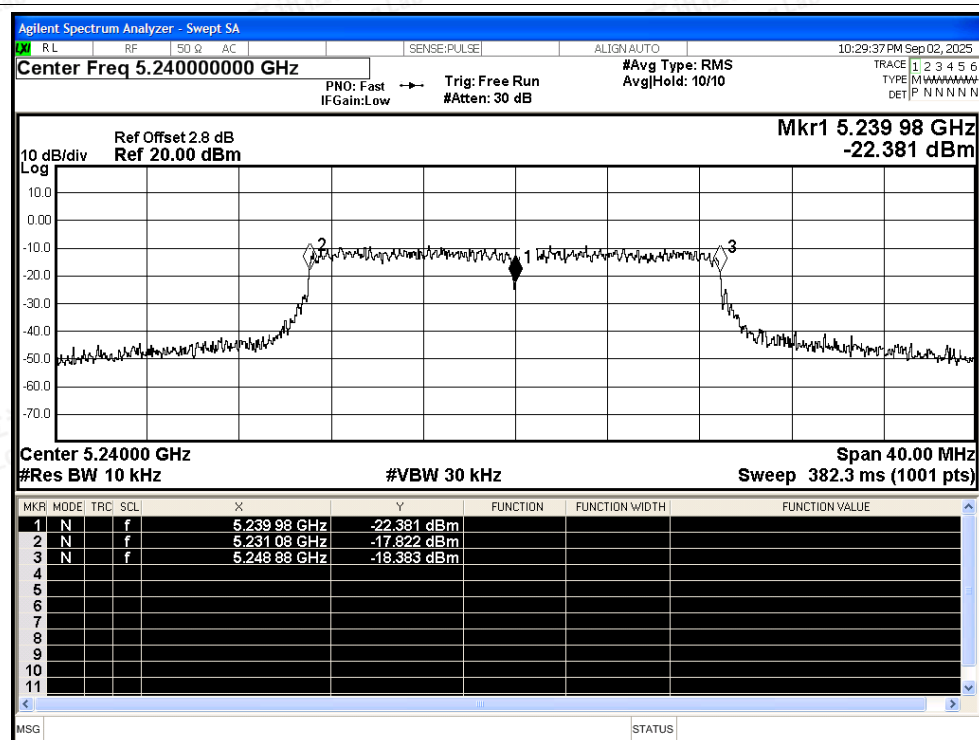

Freq. Stability NVNT be40 5190MHz Ant4

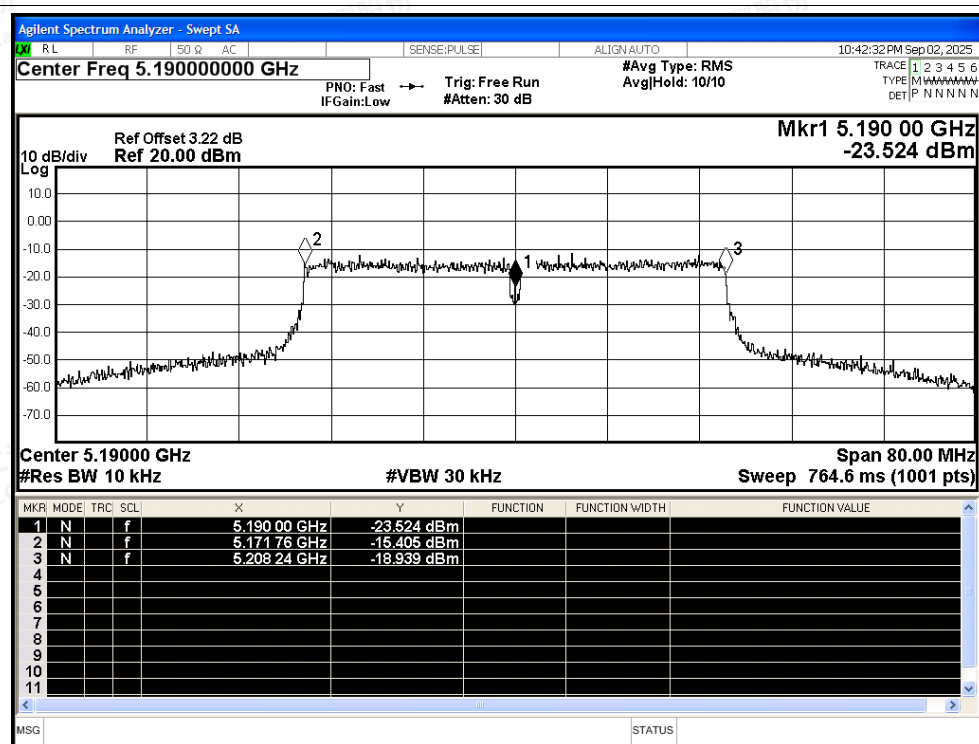

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT be40 5230MHz Ant4

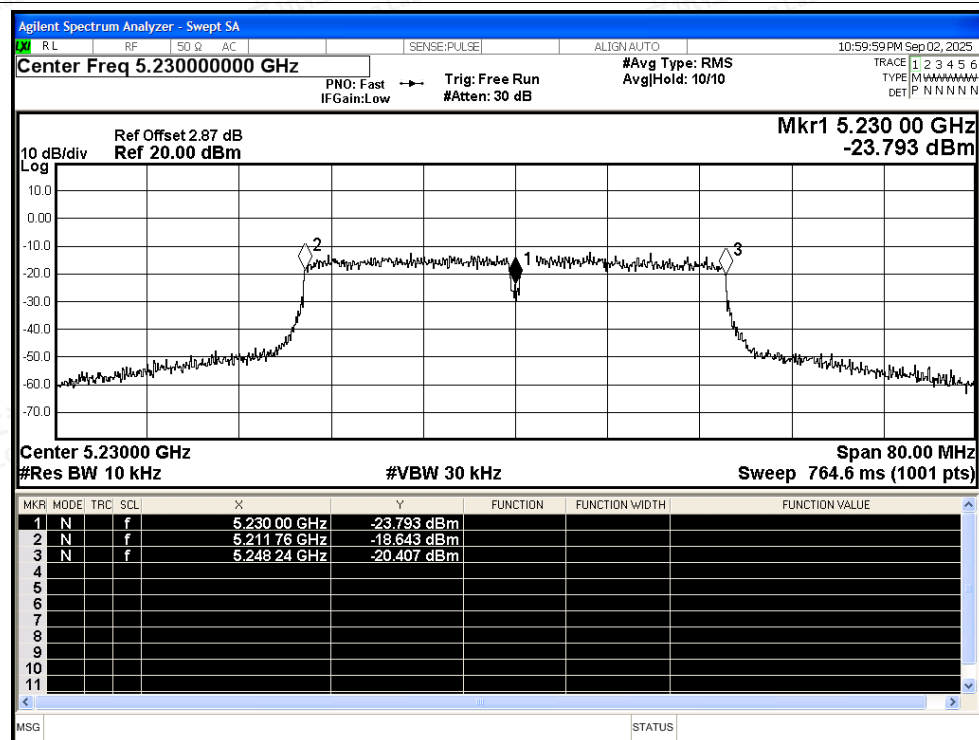


Freq. Stability NVNT be80 5210MHz Ant4

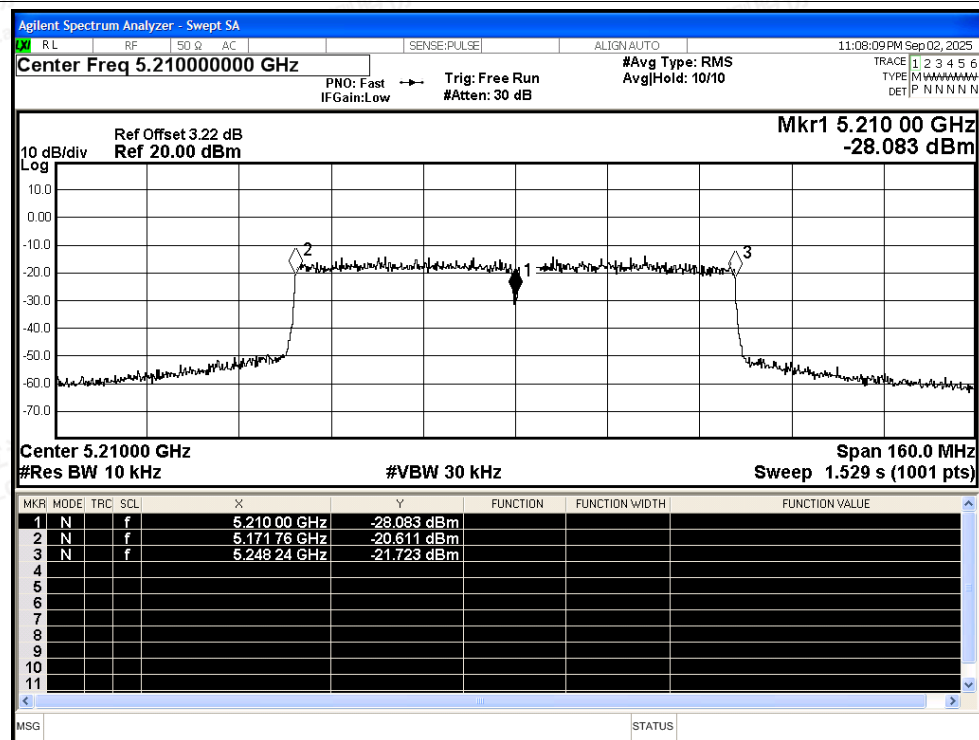


Freq. Stability NVNT ac160 5250MHz Ant4



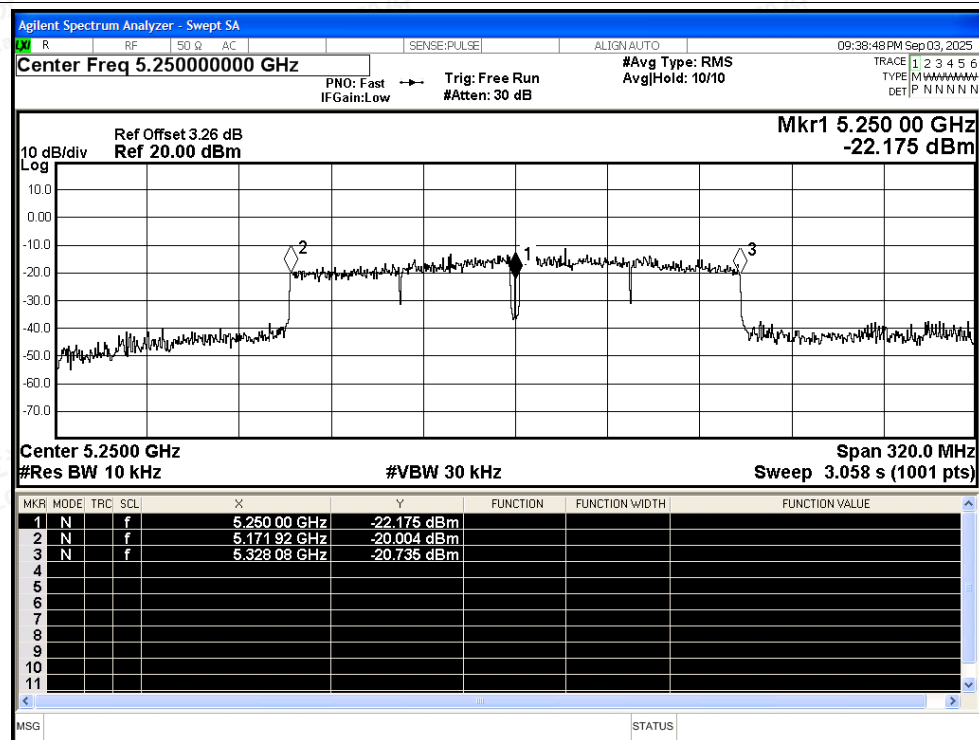

Freq. Stability NVNT ax160 5250MHz Ant4

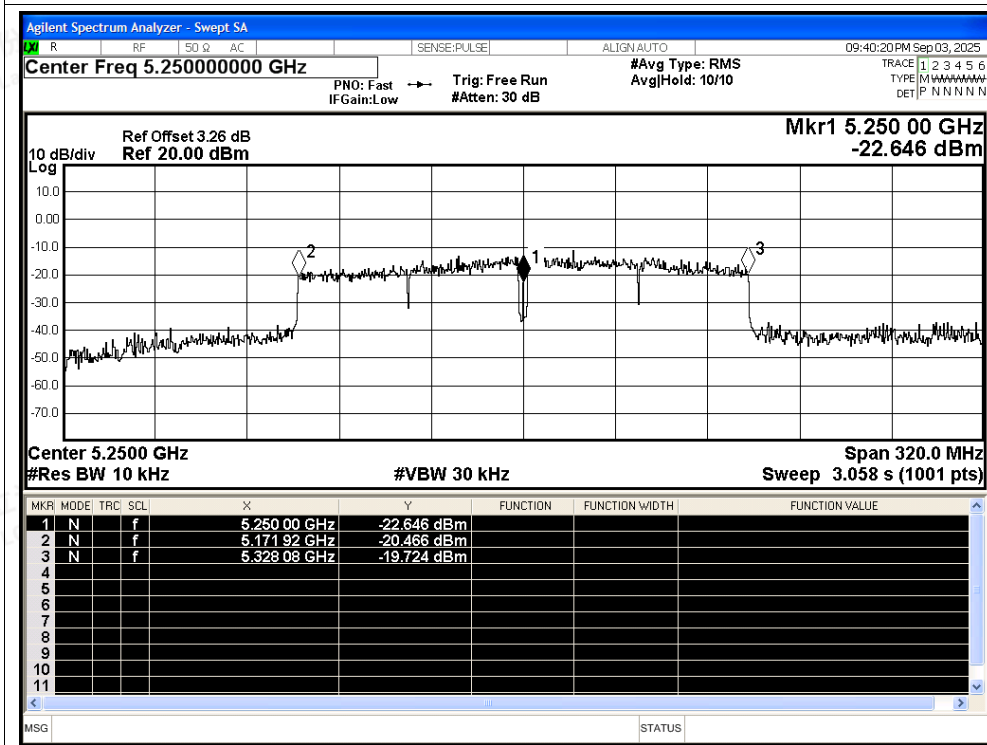


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

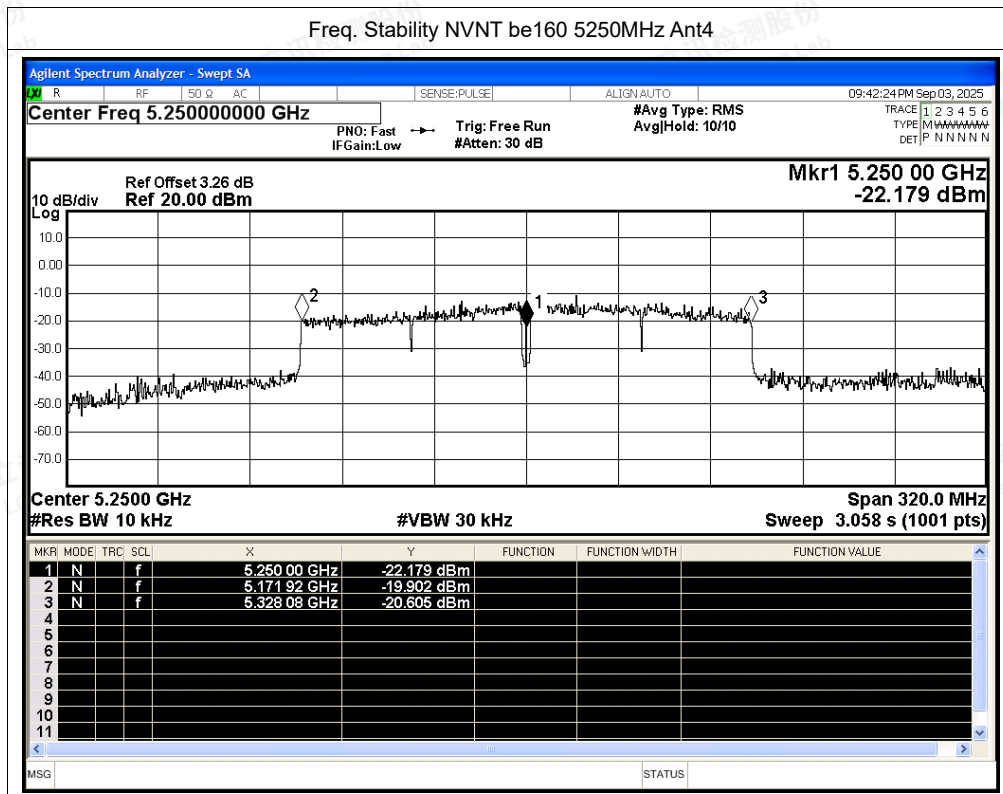



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant5	5180	0	0	25	Pass
NVNT	a	5200	Ant5	5200	0	0	25	Pass
NVNT	a	5240	Ant5	5240	0	0	25	Pass
NVNT	n20	5180	Ant5	5180	0	0	25	Pass
NVNT	n20	5200	Ant5	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant5	5240	0	0	25	Pass
NVNT	n40	5190	Ant5	5190	0	0	25	Pass
NVNT	n40	5230	Ant5	5230	0	0	25	Pass
NVNT	ac20	5180	Ant5	5180	0	0	25	Pass
NVNT	ac20	5200	Ant5	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant5	5240	0	0	25	Pass
NVNT	ac40	5190	Ant5	5190	0	0	25	Pass
NVNT	ac40	5230	Ant5	5230	0	0	25	Pass
NVNT	ac80	5210	Ant5	5210	0	0	25	Pass
NVNT	ax20	5180	Ant5	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant5	5200	0	0	25	Pass
NVNT	ax20	5240	Ant5	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant5	5190	0	0	25	Pass
NVNT	ax40	5230	Ant5	5230	0	0	25	Pass
NVNT	ax80	5210	Ant5	5210	0	0	25	Pass
NVNT	be20	5180	Ant5	5180	0	0	25	Pass
NVNT	be20	5200	Ant5	5200	0	0	25	Pass
NVNT	be20	5240	Ant5	5240	0	0	25	Pass
NVNT	be40	5190	Ant5	5190	0	0	25	Pass
NVNT	be40	5230	Ant5	5230	0	0	25	Pass
NVNT	be80	5210	Ant5	5210	0	0	25	Pass
NVNT	ac160	5250	Ant5	5250	0	0	25	Pass
NVNT	ax160	5250	Ant5	5250	0	0	25	Pass
NVNT	be160	5250	Ant5	5250	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity