





PSD NVNT ax20 5825MHz Ant5

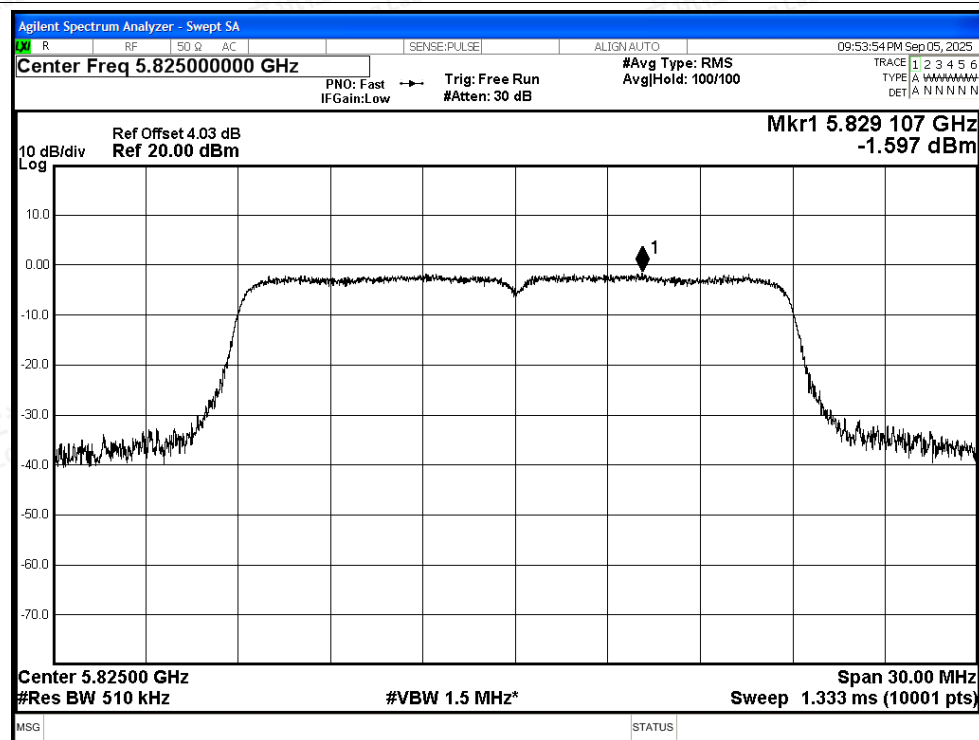


PSD NVNT ax40 5755MHz Ant5

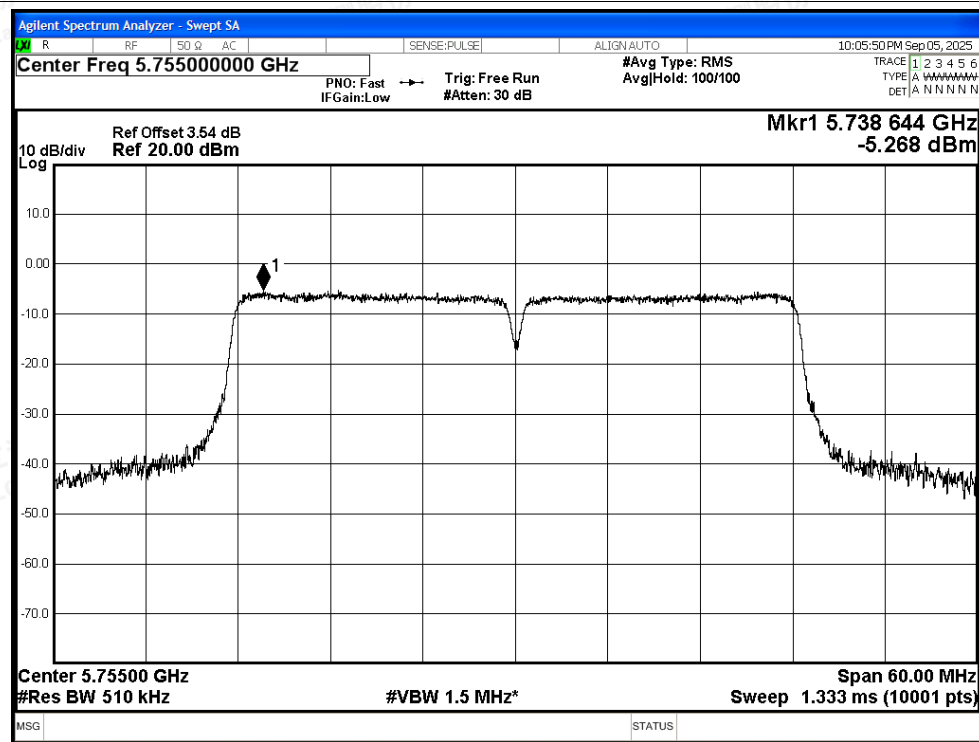




PSD NVNT ax40 5795MHz Ant5

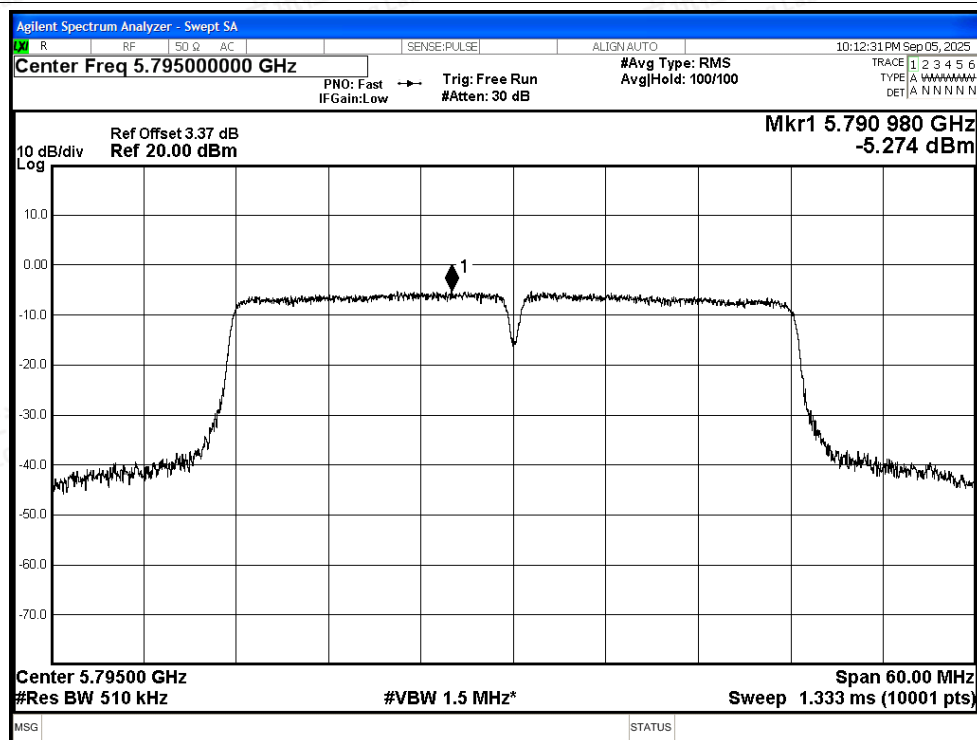

PSD NVNT ax80 5775MHz Ant5


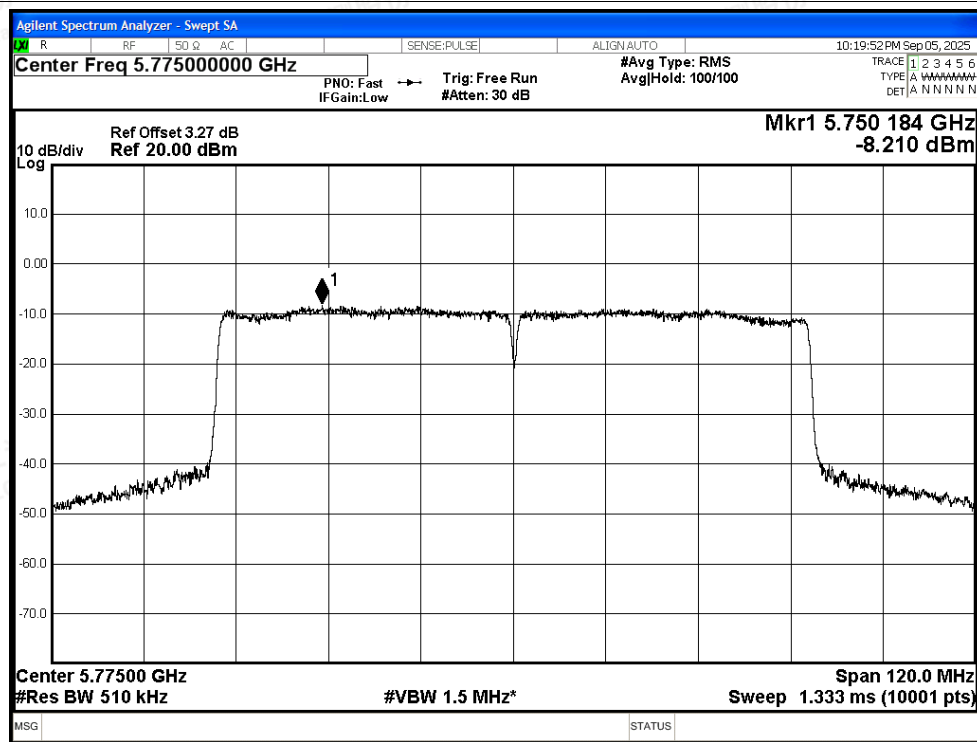


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

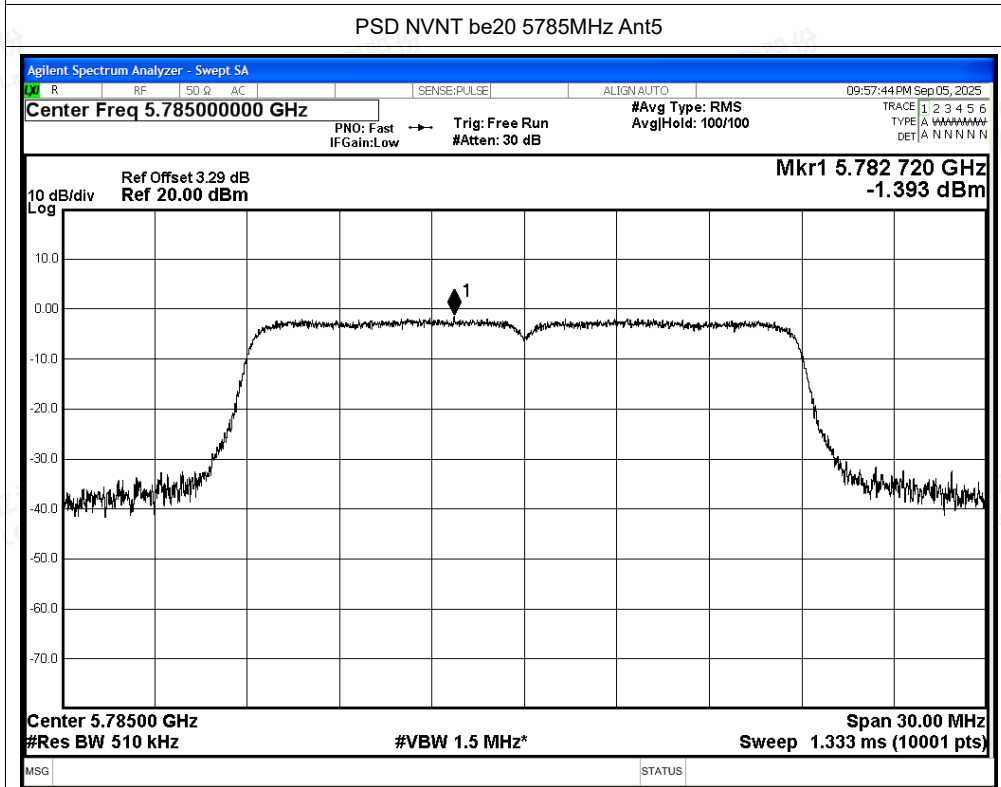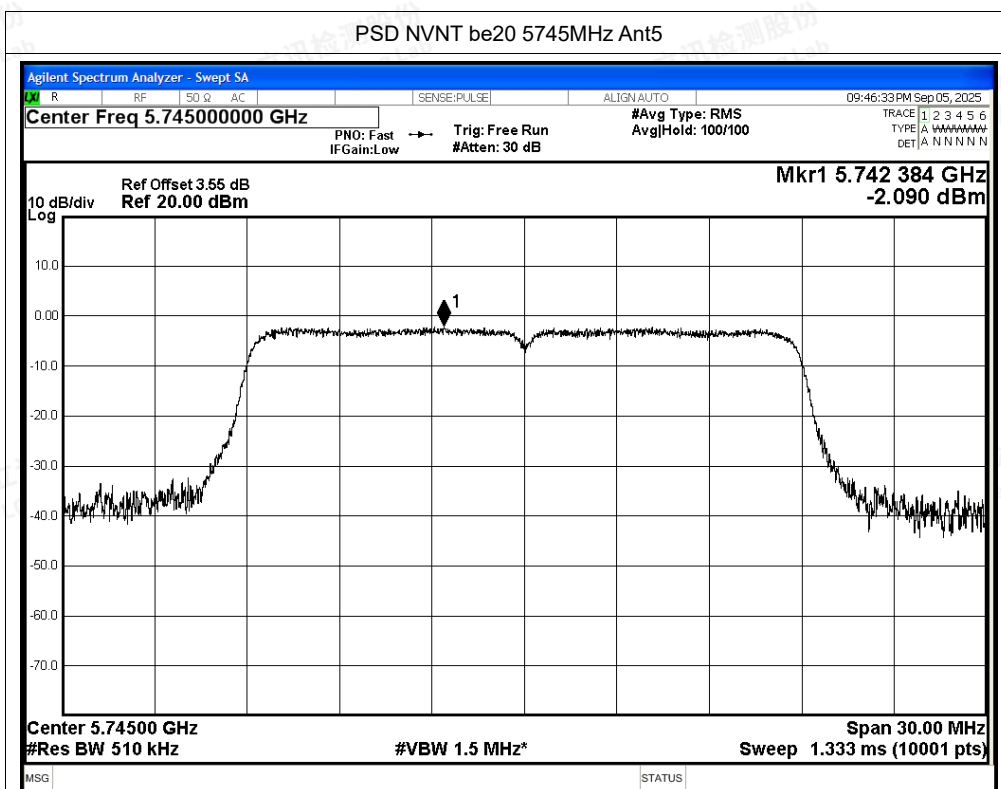


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



PSD NVNT be20 5825MHz Ant5

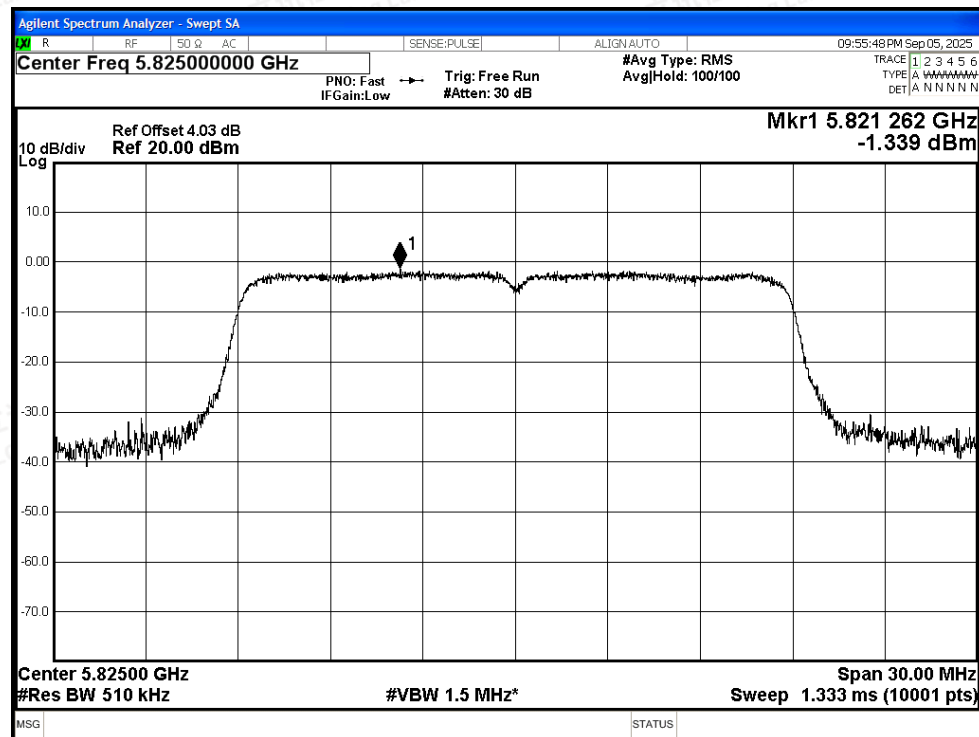


PSD NVNT be40 5755MHz Ant5

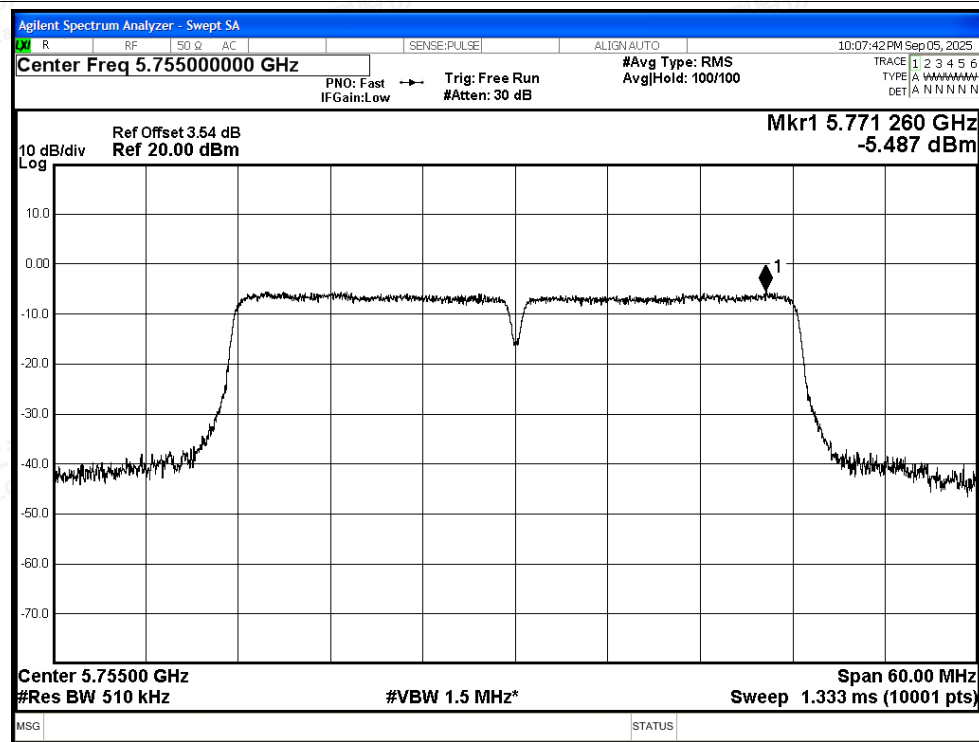




PSD NVNT be40 5795MHz Ant5

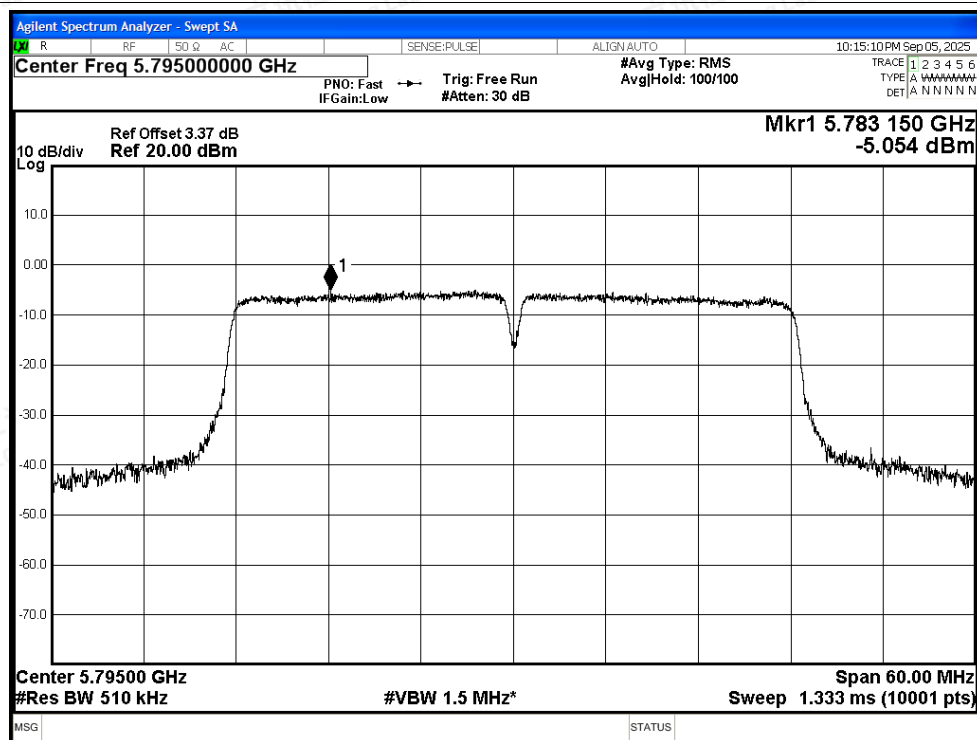

PSD NVNT be80 5775MHz Ant5

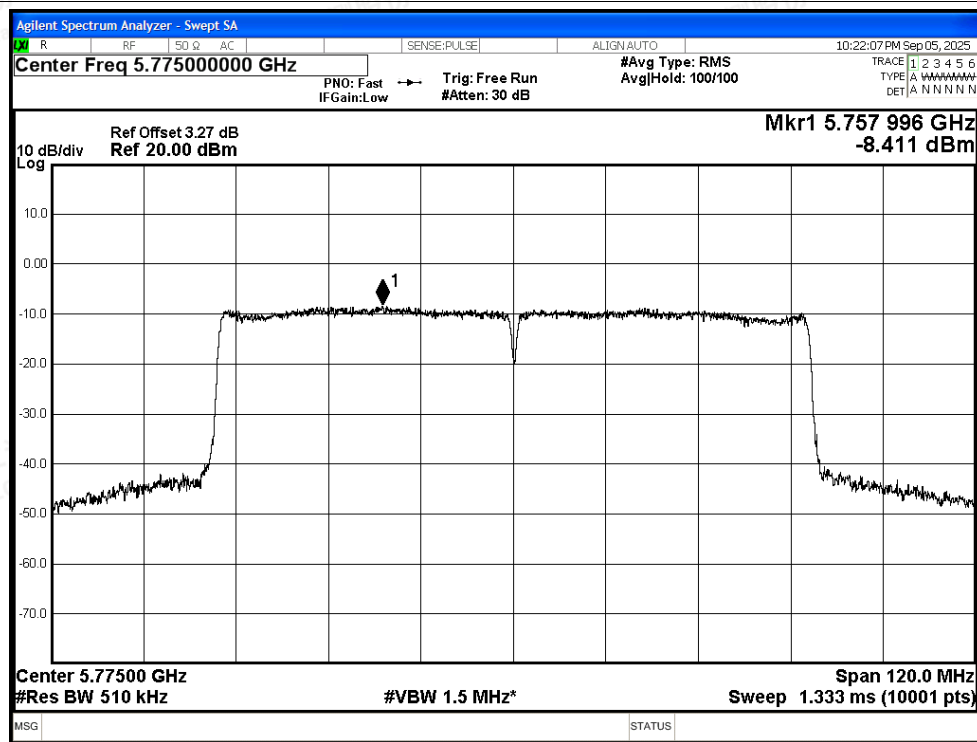

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant3	5650	-49.56	4.17	-	-45.39	Peak	-27	Pass
NVNT	a	5745	Ant3	5650	-57.19	4.17	0.24	-52.78	Average	-27	Pass
NVNT	a	5745	Ant3	5700	-46.17	4.17	-	-42.00	Peak	10	Pass
NVNT	a	5745	Ant3	5700	-54.88	4.17	0.24	-50.47	Average	10	Pass
NVNT	a	5745	Ant3	5720	-32.11	4.17	-	-27.94	Peak	15.6	Pass
NVNT	a	5745	Ant3	5720	-46.58	4.17	0.24	-42.17	Average	15.6	Pass
NVNT	a	5745	Ant3	5725	-31.37	4.17	-	-27.20	Peak	27	Pass
NVNT	a	5745	Ant3	5725	-40.26	4.17	0.24	-35.85	Average	27	Pass
NVNT	a	5825	Ant3	5850	-37.1	4.17	-	-32.93	Peak	27	Pass
NVNT	a	5825	Ant3	5850	-48.13	4.17	0.24	-43.72	Average	27	Pass
NVNT	a	5825	Ant3	5855	-40.6	4.17	-	-36.43	Peak	15.6	Pass
NVNT	a	5825	Ant3	5855	-51.81	4.17	0.24	-47.40	Average	15.6	Pass
NVNT	a	5825	Ant3	5875	-47.28	4.17	-	-43.11	Peak	10	Pass
NVNT	a	5825	Ant3	5875	-54.09	4.17	0.24	-49.68	Average	10	Pass
NVNT	a	5825	Ant3	5925	-48.05	4.17	-	-43.88	Peak	-27	Pass
NVNT	a	5825	Ant3	5925	-55.7	4.17	0.24	-51.29	Average	-27	Pass
NVNT	n20	5745	Ant3	5650	-47.98	4.17	-	-43.81	Peak	-27	Pass
NVNT	n20	5745	Ant3	5650	-56.9	4.17	0.12	-52.61	Average	-27	Pass
NVNT	n20	5745	Ant3	5700	-46.84	4.17	-	-42.67	Peak	10	Pass
NVNT	n20	5745	Ant3	5700	-55.3	4.17	0.12	-51.01	Average	10	Pass
NVNT	n20	5745	Ant3	5720	-36.77	4.17	-	-32.60	Peak	15.6	Pass
NVNT	n20	5745	Ant3	5720	-46.12	4.17	0.12	-41.83	Average	15.6	Pass
NVNT	n20	5745	Ant3	5725	-25.18	4.17	-	-21.01	Peak	27	Pass
NVNT	n20	5745	Ant3	5725	-40.6	4.17	0.12	-36.31	Average	27	Pass
NVNT	n20	5825	Ant3	5850	-29.95	4.17	-	-25.78	Peak	27	Pass
NVNT	n20	5825	Ant3	5850	-44.99	4.17	0.12	-40.70	Average	27	Pass
NVNT	n20	5825	Ant3	5855	-37.77	4.17	-	-33.60	Peak	15.6	Pass
NVNT	n20	5825	Ant3	5855	-50.57	4.17	0.12	-46.28	Average	15.6	Pass
NVNT	n20	5825	Ant3	5875	-47.29	4.17	-	-43.12	Peak	10	Pass
NVNT	n20	5825	Ant3	5875	-55.24	4.17	0.12	-50.95	Average	10	Pass
NVNT	n20	5825	Ant3	5925	-47.41	4.17	-	-43.24	Peak	-27	Pass
NVNT	n20	5825	Ant3	5925	-55.39	4.17	0.12	-51.10	Average	-27	Pass
NVNT	n40	5755	Ant3	5650	-47.7	4.17	-	-43.53	Peak	-27	Pass
NVNT	n40	5755	Ant3	5650	-56.39	4.17	0.24	-51.98	Average	-27	Pass
NVNT	n40	5755	Ant3	5700	-42.2	4.17	-	-38.03	Peak	10	Pass
NVNT	n40	5755	Ant3	5700	-51.88	4.17	0.24	-47.47	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant3	5720	-27.12	4.17	-	-22.95	Peak	15.6	Pass
NVNT	n40	5755	Ant3	5720	-39.28	4.17	0.24	-34.87	Average	15.6	Pass
NVNT	n40	5755	Ant3	5725	-27.52	4.17	-	-23.35	Peak	27	Pass
NVNT	n40	5755	Ant3	5725	-37.22	4.17	0.24	-32.81	Average	27	Pass
NVNT	n40	5795	Ant3	5850	-46.31	4.17	-	-42.14	Peak	27	Pass
NVNT	n40	5795	Ant3	5850	-54.09	4.17	0.24	-49.68	Average	27	Pass
NVNT	n40	5795	Ant3	5855	-46.57	4.17	-	-42.40	Peak	15.6	Pass
NVNT	n40	5795	Ant3	5855	-54.27	4.17	0.24	-49.86	Average	15.6	Pass
NVNT	n40	5795	Ant3	5875	-47.67	4.17	-	-43.50	Peak	10	Pass
NVNT	n40	5795	Ant3	5875	-57.06	4.17	0.24	-52.65	Average	10	Pass
NVNT	n40	5795	Ant3	5925	-47.57	4.17	-	-43.40	Peak	-27	Pass
NVNT	n40	5795	Ant3	5925	-57.29	4.17	0.24	-52.88	Average	-27	Pass
NVNT	ac20	5745	Ant3	5650	-49.29	4.17	-	-45.12	Peak	-27	Pass
NVNT	ac20	5745	Ant3	5650	-56.27	4.17	0.12	-51.98	Average	-27	Pass
NVNT	ac20	5745	Ant3	5700	-46.64	4.17	-	-42.47	Peak	10	Pass
NVNT	ac20	5745	Ant3	5700	-54.28	4.17	0.12	-49.99	Average	10	Pass
NVNT	ac20	5745	Ant3	5720	-33.41	4.17	-	-29.24	Peak	15.6	Pass
NVNT	ac20	5745	Ant3	5720	-45.9	4.17	0.12	-41.61	Average	15.6	Pass
NVNT	ac20	5745	Ant3	5725	-24.27	4.17	-	-20.10	Peak	27	Pass
NVNT	ac20	5745	Ant3	5725	-39.35	4.17	0.12	-35.06	Average	27	Pass
NVNT	ac20	5825	Ant3	5850	-31.37	4.17	-	-27.20	Peak	27	Pass
NVNT	ac20	5825	Ant3	5850	-44.94	4.17	0.12	-40.65	Average	27	Pass
NVNT	ac20	5825	Ant3	5855	-38.64	4.17	-	-34.47	Peak	15.6	Pass
NVNT	ac20	5825	Ant3	5855	-51.17	4.17	0.12	-46.88	Average	15.6	Pass
NVNT	ac20	5825	Ant3	5875	-46.46	4.17	-	-42.29	Peak	10	Pass
NVNT	ac20	5825	Ant3	5875	-55.24	4.17	0.12	-50.95	Average	10	Pass
NVNT	ac20	5825	Ant3	5925	-45.65	4.17	-	-41.48	Peak	-27	Pass
NVNT	ac20	5825	Ant3	5925	-55.23	4.17	0.12	-50.94	Average	-27	Pass
NVNT	ac40	5755	Ant3	5650	-50	4.17	-	-45.83	Peak	-27	Pass
NVNT	ac40	5755	Ant3	5650	-56.34	4.17	0.24	-51.93	Average	-27	Pass
NVNT	ac40	5755	Ant3	5700	-44.11	4.17	-	-39.94	Peak	10	Pass
NVNT	ac40	5755	Ant3	5700	-51.94	4.17	0.24	-47.53	Average	10	Pass
NVNT	ac40	5755	Ant3	5720	-29.35	4.17	-	-25.18	Peak	15.6	Pass
NVNT	ac40	5755	Ant3	5720	-39.82	4.17	0.24	-35.41	Average	15.6	Pass
NVNT	ac40	5755	Ant3	5725	-27.61	4.17	-	-23.44	Peak	27	Pass
NVNT	ac40	5755	Ant3	5725	-38.09	4.17	0.24	-33.68	Average	27	Pass
NVNT	ac40	5795	Ant3	5850	-45.17	4.17	-	-41.00	Peak	27	Pass
NVNT	ac40	5795	Ant3	5850	-54.04	4.17	0.24	-49.63	Average	27	Pass
NVNT	ac40	5795	Ant3	5855	-44.53	4.17	-	-40.36	Peak	15.6	Pass
NVNT	ac40	5795	Ant3	5855	-54.51	4.17	0.24	-50.10	Average	15.6	Pass
NVNT	ac40	5795	Ant3	5875	-49.74	4.17	-	-45.57	Peak	10	Pass





NVNT	ac40	5795	Ant3	5875	-57.55	4.17	0.24	-53.14	Average	10	Pass
NVNT	ac40	5795	Ant3	5925	-48.35	4.17	-	-44.18	Peak	-27	Pass
NVNT	ac40	5795	Ant3	5925	-57.12	4.17	0.24	-52.71	Average	-27	Pass
NVNT	ac80	5775	Ant3	5850	-33.12	4.17	-	-28.95	Peak	27	Pass
NVNT	ac80	5775	Ant3	5850	-43.99	4.17	0.47	-39.35	Average	27	Pass
NVNT	ac80	5775	Ant3	5855	-35.64	4.17	-	-31.47	Peak	15.6	Pass
NVNT	ac80	5775	Ant3	5855	-44.3	4.17	0.47	-39.66	Average	15.6	Pass
NVNT	ac80	5775	Ant3	5875	-41.61	4.17	-	-37.44	Peak	10	Pass
NVNT	ac80	5775	Ant3	5875	-50.6	4.17	0.47	-45.96	Average	10	Pass
NVNT	ac80	5775	Ant3	5925	-47.87	4.17	-	-43.70	Peak	-27	Pass
NVNT	ac80	5775	Ant3	5925	-56.9	4.17	0.47	-52.26	Average	-27	Pass
NVNT	ac80	5775	Ant3	5650	-46.93	4.17	-	-42.76	Peak	-27	Pass
NVNT	ac80	5775	Ant3	5650	-55.38	4.17	0.47	-50.74	Average	-27	Pass
NVNT	ac80	5775	Ant3	5700	-33.29	4.17	-	-29.12	Peak	10	Pass
NVNT	ac80	5775	Ant3	5700	-44.86	4.17	0.47	-40.22	Average	10	Pass
NVNT	ac80	5775	Ant3	5720	-29.02	4.17	-	-24.85	Peak	15.6	Pass
NVNT	ac80	5775	Ant3	5720	-39.82	4.17	0.47	-35.18	Average	15.6	Pass
NVNT	ac80	5775	Ant3	5725	-28.35	4.17	-	-24.18	Peak	27	Pass
NVNT	ac80	5775	Ant3	5725	-40.34	4.17	0.47	-35.70	Average	27	Pass
NVNT	ax20	5745	Ant3	5650	-48.98	4.17	-	-44.81	Peak	-27	Pass
NVNT	ax20	5745	Ant3	5650	-56.72	4.17	0.12	-52.43	Average	-27	Pass
NVNT	ax20	5745	Ant3	5700	-45.65	4.17	-	-41.48	Peak	10	Pass
NVNT	ax20	5745	Ant3	5700	-54.63	4.17	0.12	-50.34	Average	10	Pass
NVNT	ax20	5745	Ant3	5720	-33.78	4.17	-	-29.61	Peak	15.6	Pass
NVNT	ax20	5745	Ant3	5720	-46.05	4.17	0.12	-41.76	Average	15.6	Pass
NVNT	ax20	5745	Ant3	5725	-22.49	4.17	-	-18.32	Peak	27	Pass
NVNT	ax20	5745	Ant3	5725	-39.2	4.17	0.12	-34.91	Average	27	Pass
NVNT	ax20	5825	Ant3	5850	-28.52	4.17	-	-24.35	Peak	27	Pass
NVNT	ax20	5825	Ant3	5850	-45.58	4.17	0.12	-41.29	Average	27	Pass
NVNT	ax20	5825	Ant3	5855	-40.52	4.17	-	-36.35	Peak	15.6	Pass
NVNT	ax20	5825	Ant3	5855	-51.77	4.17	0.12	-47.48	Average	15.6	Pass
NVNT	ax20	5825	Ant3	5875	-46.49	4.17	-	-42.32	Peak	10	Pass
NVNT	ax20	5825	Ant3	5875	-54.67	4.17	0.12	-50.38	Average	10	Pass
NVNT	ax20	5825	Ant3	5925	-48.25	4.17	-	-44.08	Peak	-27	Pass
NVNT	ax20	5825	Ant3	5925	-55.25	4.17	0.12	-50.96	Average	-27	Pass
NVNT	ax40	5755	Ant3	5650	-46.86	4.17	-	-42.69	Peak	-27	Pass
NVNT	ax40	5755	Ant3	5650	-56.56	4.17	0.24	-52.15	Average	-27	Pass
NVNT	ax40	5755	Ant3	5700	-42.96	4.17	-	-38.79	Peak	10	Pass
NVNT	ax40	5755	Ant3	5700	-51.96	4.17	0.24	-47.55	Average	10	Pass
NVNT	ax40	5755	Ant3	5720	-27.13	4.17	-	-22.96	Peak	15.6	Pass
NVNT	ax40	5755	Ant3	5720	-40.25	4.17	0.24	-35.84	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5755	Ant3	5725	-27.06	4.17	-	-22.89	Peak	27	Pass
NVNT	ax40	5755	Ant3	5725	-37.2	4.17	0.24	-32.79	Average	27	Pass
NVNT	ax40	5795	Ant3	5850	-47.05	4.17	-	-42.88	Peak	27	Pass
NVNT	ax40	5795	Ant3	5850	-54.69	4.17	0.24	-50.28	Average	27	Pass
NVNT	ax40	5795	Ant3	5855	-41	4.17	-	-36.83	Peak	15.6	Pass
NVNT	ax40	5795	Ant3	5855	-55.1	4.17	0.24	-50.69	Average	15.6	Pass
NVNT	ax40	5795	Ant3	5875	-49.15	4.17	-	-44.98	Peak	10	Pass
NVNT	ax40	5795	Ant3	5875	-57.27	4.17	0.24	-52.86	Average	10	Pass
NVNT	ax40	5795	Ant3	5925	-49.93	4.17	-	-45.76	Peak	-27	Pass
NVNT	ax40	5795	Ant3	5925	-56.89	4.17	0.24	-52.48	Average	-27	Pass
NVNT	ax80	5775	Ant3	5850	-34.27	4.17	-	-30.10	Peak	27	Pass
NVNT	ax80	5775	Ant3	5850	-43.97	4.17	0.47	-39.33	Average	27	Pass
NVNT	ax80	5775	Ant3	5855	-36.55	4.17	-	-32.38	Peak	15.6	Pass
NVNT	ax80	5775	Ant3	5855	-43.79	4.17	0.47	-39.15	Average	15.6	Pass
NVNT	ax80	5775	Ant3	5875	-39.77	4.17	-	-35.60	Peak	10	Pass
NVNT	ax80	5775	Ant3	5875	-50.79	4.17	0.47	-46.15	Average	10	Pass
NVNT	ax80	5775	Ant3	5925	-49.04	4.17	-	-44.87	Peak	-27	Pass
NVNT	ax80	5775	Ant3	5925	-56.62	4.17	0.47	-51.98	Average	-27	Pass
NVNT	ax80	5775	Ant3	5650	-46.65	4.17	-	-42.48	Peak	-27	Pass
NVNT	ax80	5775	Ant3	5650	-54.5	4.17	0.47	-49.86	Average	-27	Pass
NVNT	ax80	5775	Ant3	5700	-35.93	4.17	-	-31.76	Peak	10	Pass
NVNT	ax80	5775	Ant3	5700	-45.07	4.17	0.47	-40.43	Average	10	Pass
NVNT	ax80	5775	Ant3	5720	-31.58	4.17	-	-27.41	Peak	15.6	Pass
NVNT	ax80	5775	Ant3	5720	-39.89	4.17	0.47	-35.25	Average	15.6	Pass
NVNT	ax80	5775	Ant3	5725	-26.91	4.17	-	-22.74	Peak	27	Pass
NVNT	ax80	5775	Ant3	5725	-39.66	4.17	0.47	-35.02	Average	27	Pass
NVNT	be20	5745	Ant3	5650	-48.78	4.17	-	-44.61	Peak	-27	Pass
NVNT	be20	5745	Ant3	5650	-56.79	4.17	0.12	-52.50	Average	-27	Pass
NVNT	be20	5745	Ant3	5700	-44.74	4.17	-	-40.57	Peak	10	Pass
NVNT	be20	5745	Ant3	5700	-54.89	4.17	0.12	-50.60	Average	10	Pass
NVNT	be20	5745	Ant3	5720	-33.33	4.17	-	-29.16	Peak	15.6	Pass
NVNT	be20	5745	Ant3	5720	-47.1	4.17	0.12	-42.81	Average	15.6	Pass
NVNT	be20	5745	Ant3	5725	-22.85	4.17	-	-18.68	Peak	27	Pass
NVNT	be20	5745	Ant3	5725	-38.79	4.17	0.12	-34.50	Average	27	Pass
NVNT	be20	5825	Ant3	5850	-32.81	4.17	-	-28.64	Peak	27	Pass
NVNT	be20	5825	Ant3	5850	-46.52	4.17	0.12	-42.23	Average	27	Pass
NVNT	be20	5825	Ant3	5855	-40.3	4.17	-	-36.13	Peak	15.6	Pass
NVNT	be20	5825	Ant3	5855	-51.16	4.17	0.12	-46.87	Average	15.6	Pass
NVNT	be20	5825	Ant3	5875	-45.4	4.17	-	-41.23	Peak	10	Pass
NVNT	be20	5825	Ant3	5875	-54.81	4.17	0.12	-50.52	Average	10	Pass
NVNT	be20	5825	Ant3	5925	-45.65	4.17	-	-41.48	Peak	-27	Pass






NVNT	be20	5825	Ant3	5925	-56.03	4.17	0.12	-51.74	Average	-27	Pass
NVNT	be40	5755	Ant3	5650	-47.24	4.17	-	-43.07	Peak	-27	Pass
NVNT	be40	5755	Ant3	5650	-56.01	4.17	0.24	-51.60	Average	-27	Pass
NVNT	be40	5755	Ant3	5700	-42.64	4.17	-	-38.47	Peak	10	Pass
NVNT	be40	5755	Ant3	5700	-51.73	4.17	0.24	-47.32	Average	10	Pass
NVNT	be40	5755	Ant3	5720	-30.29	4.17	-	-26.12	Peak	15.6	Pass
NVNT	be40	5755	Ant3	5720	-39.65	4.17	0.24	-35.24	Average	15.6	Pass
NVNT	be40	5755	Ant3	5725	-26.6	4.17	-	-22.43	Peak	27	Pass
NVNT	be40	5755	Ant3	5725	-36.84	4.17	0.24	-32.43	Average	27	Pass
NVNT	be40	5795	Ant3	5850	-45.26	4.17	-	-41.09	Peak	27	Pass
NVNT	be40	5795	Ant3	5850	-54	4.17	0.24	-49.59	Average	27	Pass
NVNT	be40	5795	Ant3	5855	-45.3	4.17	-	-41.13	Peak	15.6	Pass
NVNT	be40	5795	Ant3	5855	-54.8	4.17	0.24	-50.39	Average	15.6	Pass
NVNT	be40	5795	Ant3	5875	-50.63	4.17	-	-46.46	Peak	10	Pass
NVNT	be40	5795	Ant3	5875	-57.47	4.17	0.24	-53.06	Average	10	Pass
NVNT	be40	5795	Ant3	5925	-48.67	4.17	-	-44.50	Peak	-27	Pass
NVNT	be40	5795	Ant3	5925	-57.09	4.17	0.24	-52.68	Average	-27	Pass
NVNT	be80	5775	Ant3	5850	-32.45	4.17	-	-28.28	Peak	27	Pass
NVNT	be80	5775	Ant3	5850	-43.37	4.17	0.47	-38.73	Average	27	Pass
NVNT	be80	5775	Ant3	5855	-35.24	4.17	-	-31.07	Peak	15.6	Pass
NVNT	be80	5775	Ant3	5855	-44.38	4.17	0.47	-39.74	Average	15.6	Pass
NVNT	be80	5775	Ant3	5875	-40.31	4.17	-	-36.14	Peak	10	Pass
NVNT	be80	5775	Ant3	5875	-50.98	4.17	0.47	-46.34	Average	10	Pass
NVNT	be80	5775	Ant3	5925	-49.31	4.17	-	-45.14	Peak	-27	Pass
NVNT	be80	5775	Ant3	5925	-57.23	4.17	0.47	-52.59	Average	-27	Pass
NVNT	be80	5775	Ant3	5650	-46.76	4.17	-	-42.59	Peak	-27	Pass
NVNT	be80	5775	Ant3	5650	-55.34	4.17	0.47	-50.70	Average	-27	Pass
NVNT	be80	5775	Ant3	5700	-35.88	4.17	-	-31.71	Peak	10	Pass
NVNT	be80	5775	Ant3	5700	-44.58	4.17	0.47	-39.94	Average	10	Pass
NVNT	be80	5775	Ant3	5720	-29.02	4.17	-	-24.85	Peak	15.6	Pass
NVNT	be80	5775	Ant3	5720	-40.77	4.17	0.47	-36.13	Average	15.6	Pass
NVNT	be80	5775	Ant3	5725	-28.89	4.17	-	-24.72	Peak	27	Pass
NVNT	be80	5775	Ant3	5725	-38.7	4.17	0.47	-34.06	Average	27	Pass






Test Graphs

Restrict Band NVNT a 5745MHz Ant3 Peak

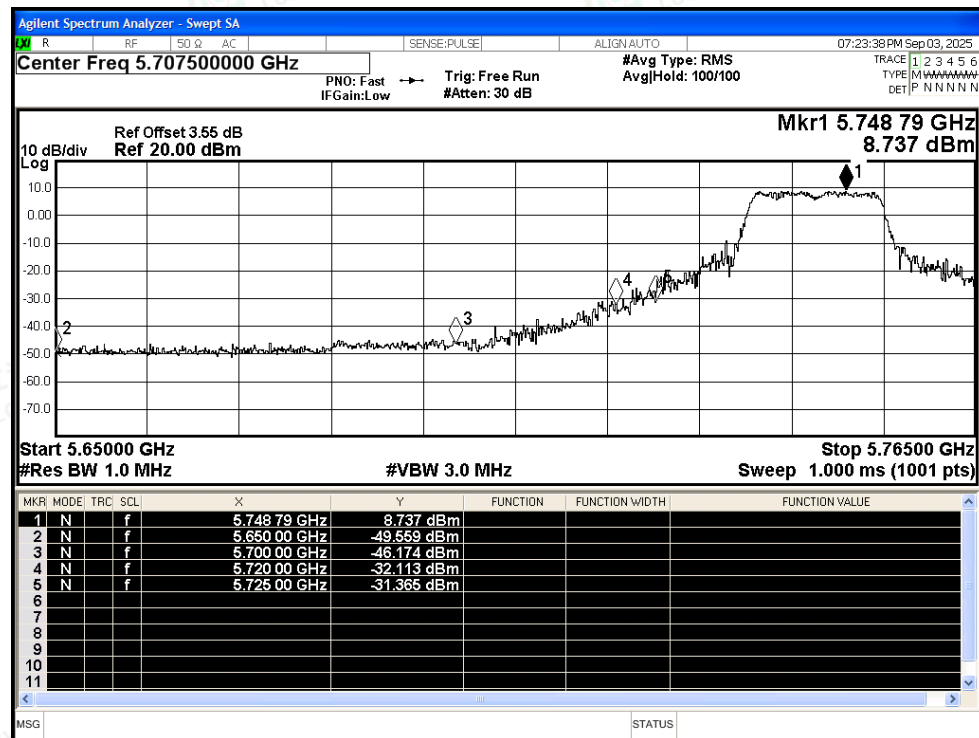

Restrict Band NVNT a 5745MHz Ant3 Average

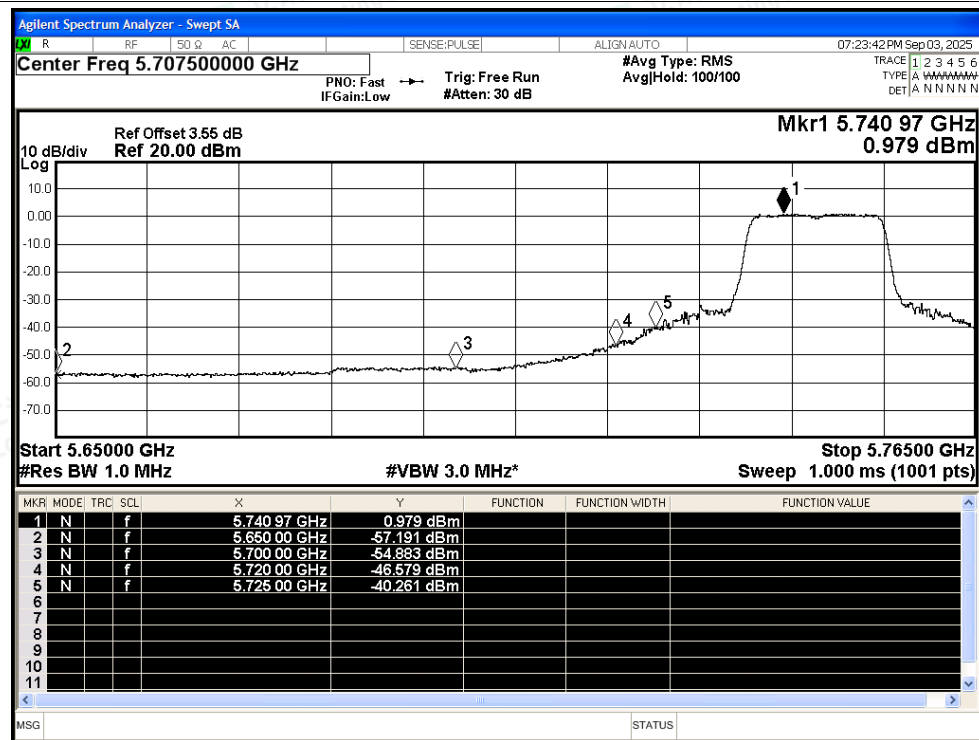

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant3 Peak

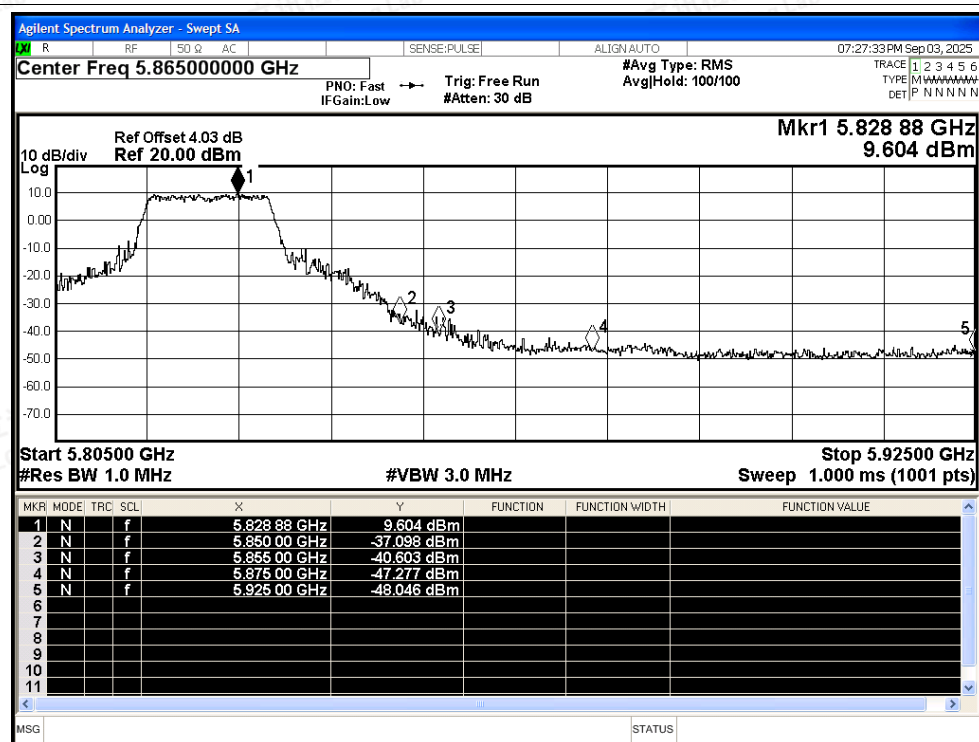

Restrict Band NVNT a 5825MHz Ant3 Average

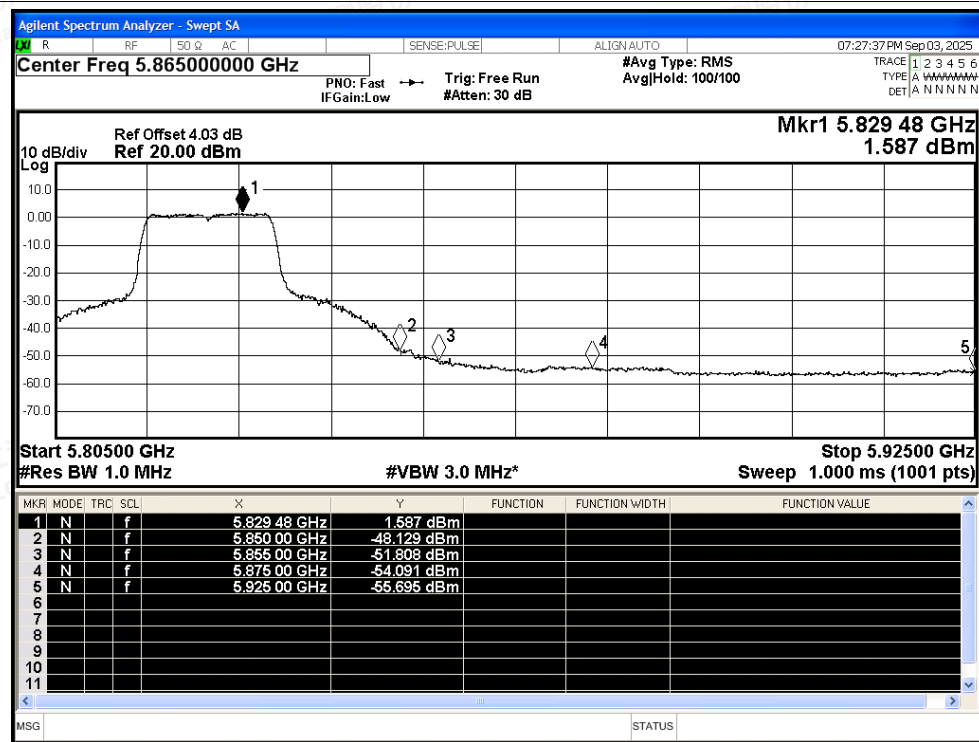

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5745MHz Ant3 Peak

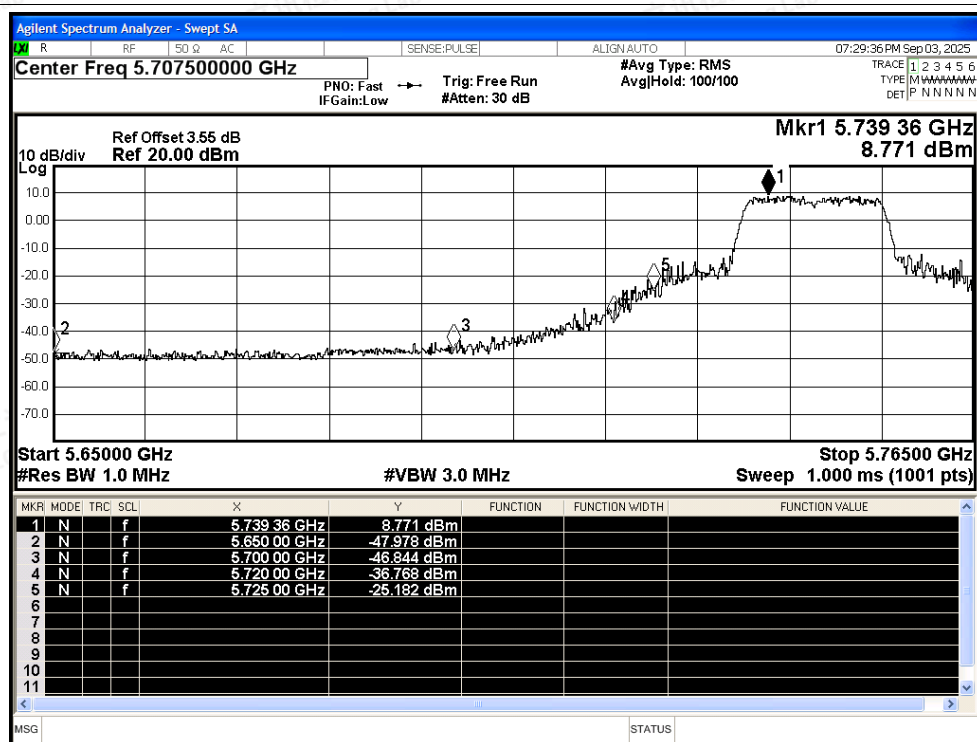

Restrict Band NVNT n20 5745MHz Ant3 Average

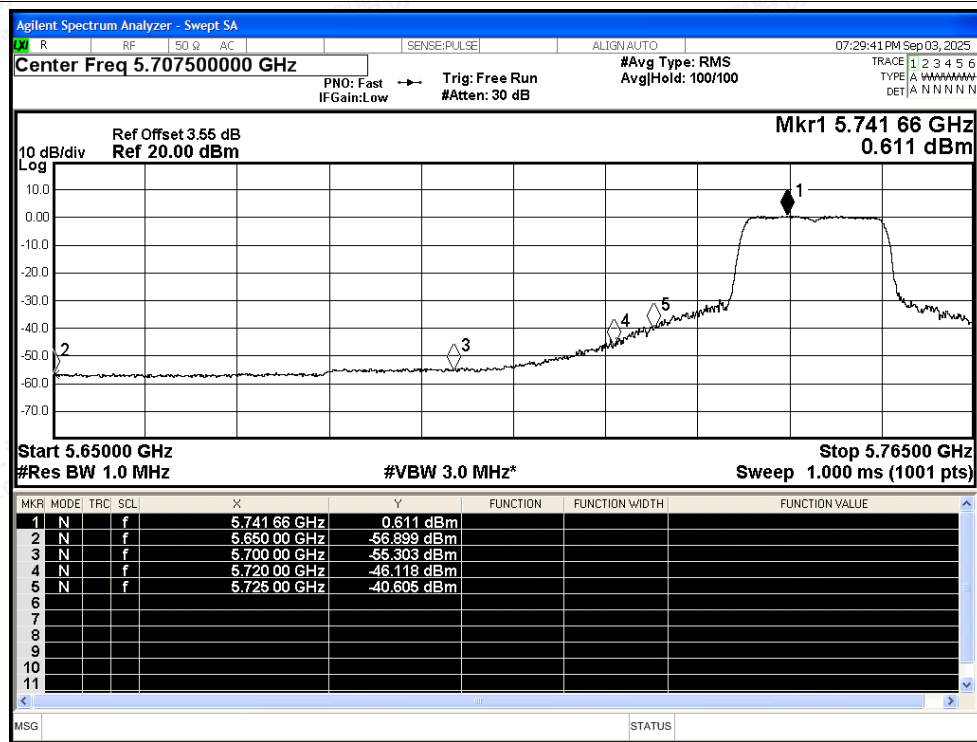

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant3 Peak

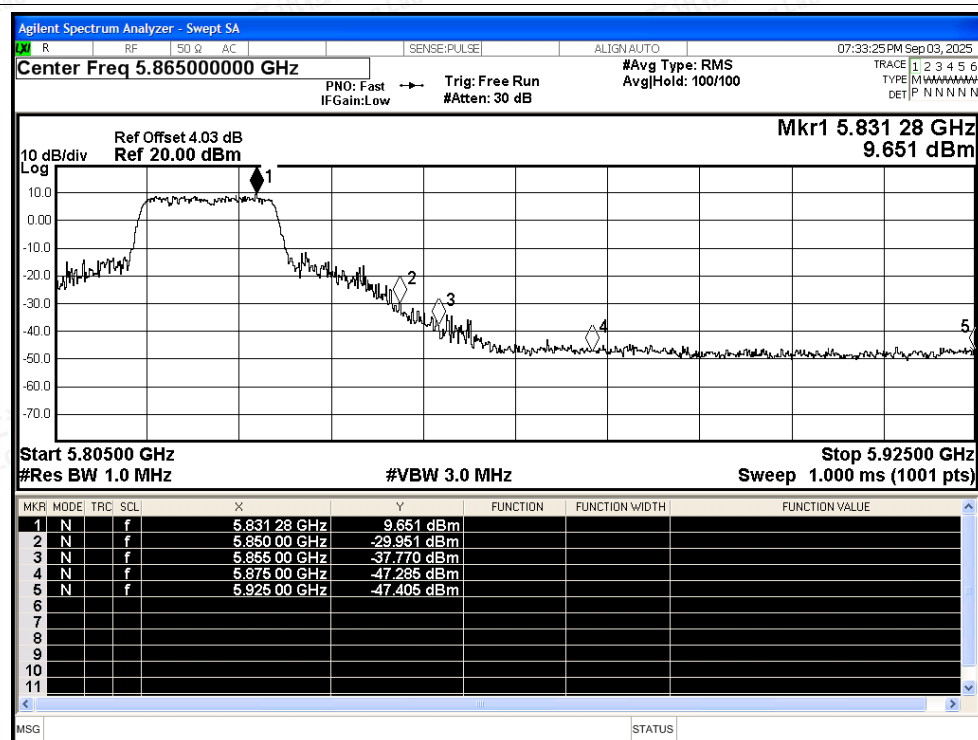

Restrict Band NVNT n20 5825MHz Ant3 Average

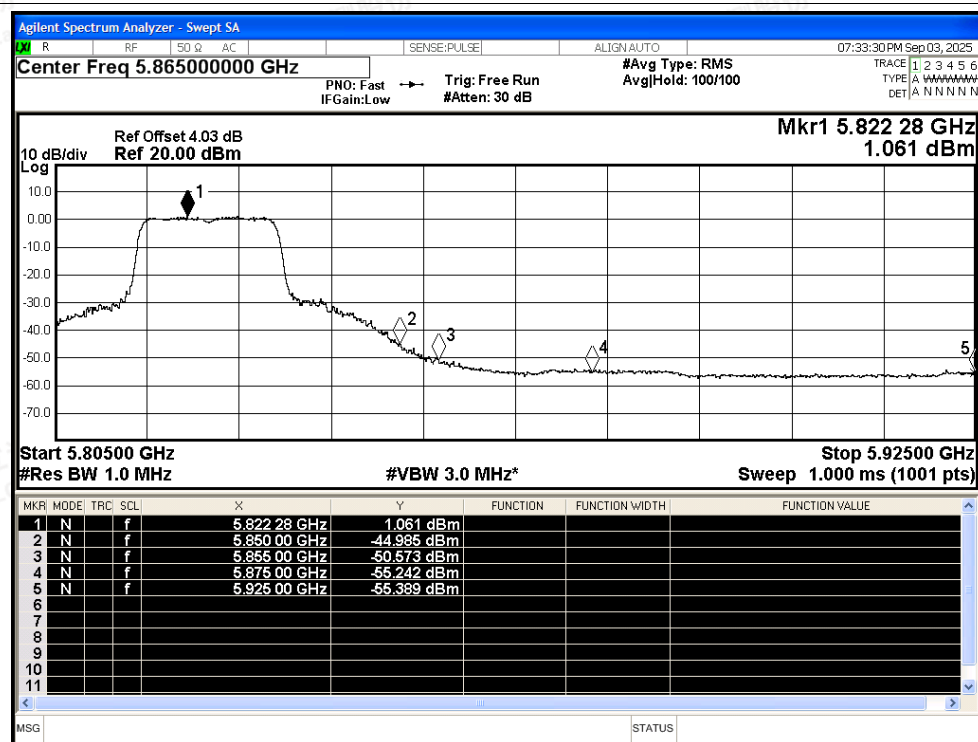

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant3 Peak

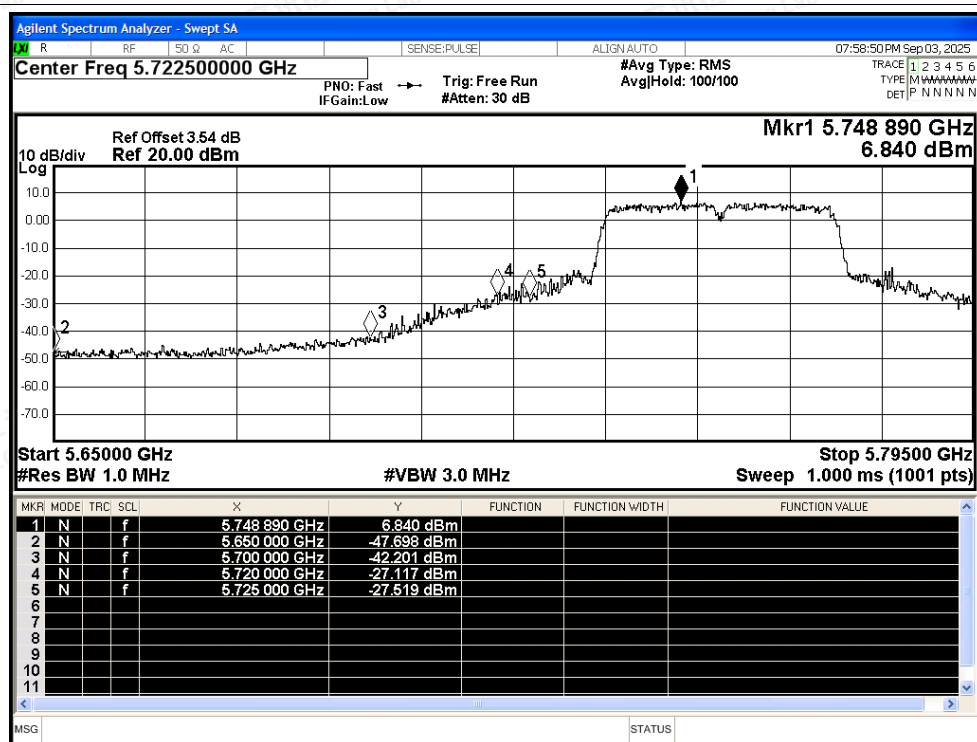

Restrict Band NVNT n40 5755MHz Ant3 Average

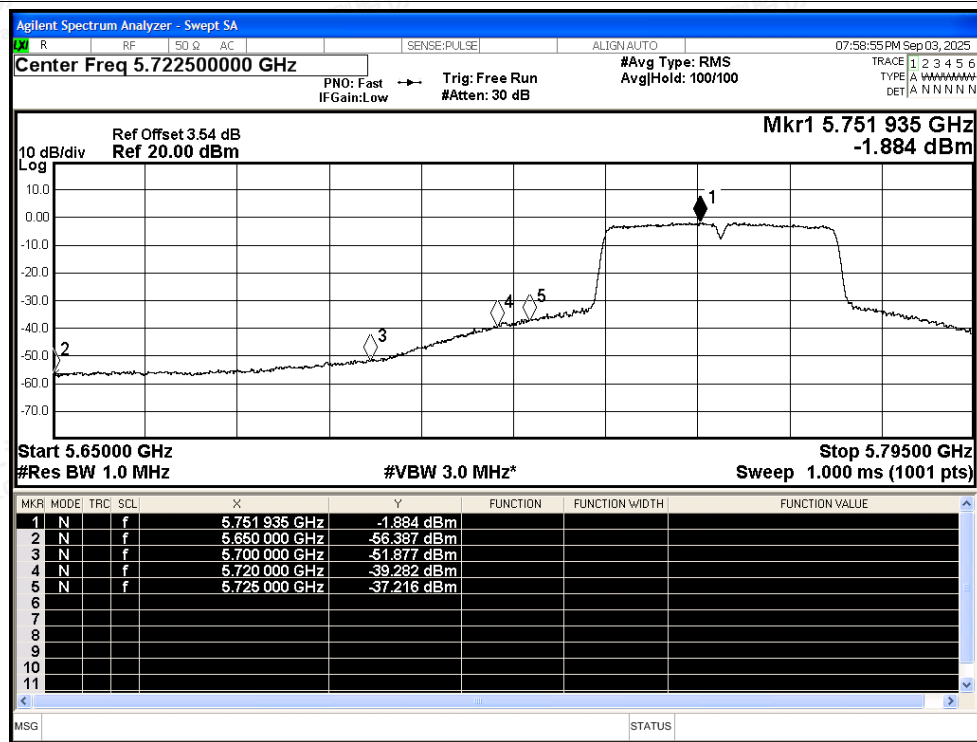

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant3 Peak

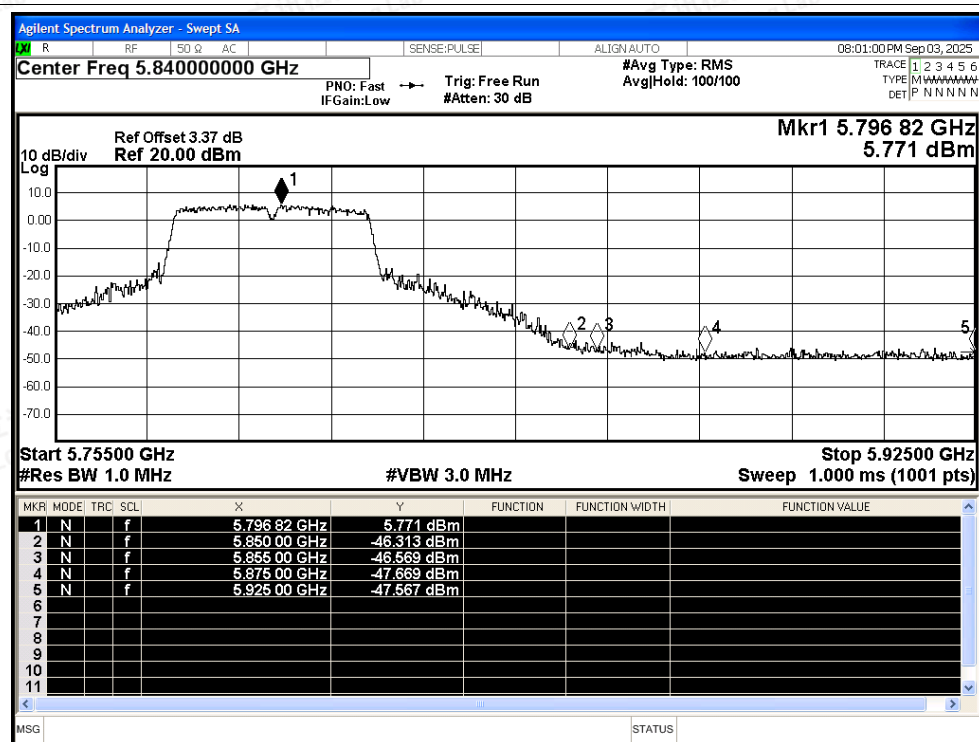

Restrict Band NVNT n40 5795MHz Ant3 Average

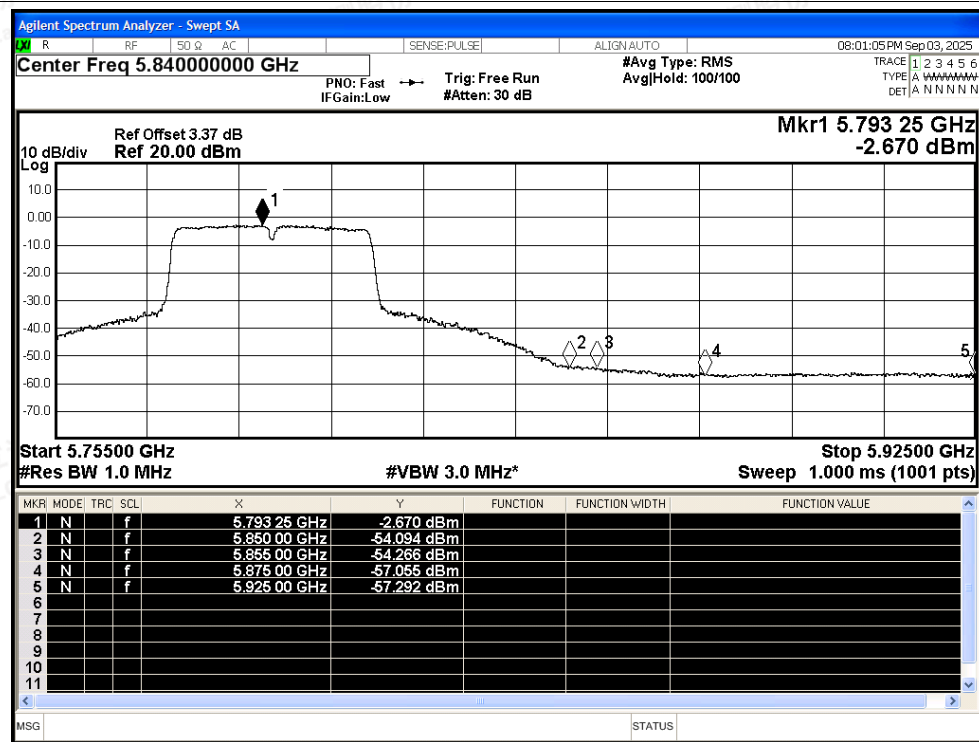

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant3 Peak

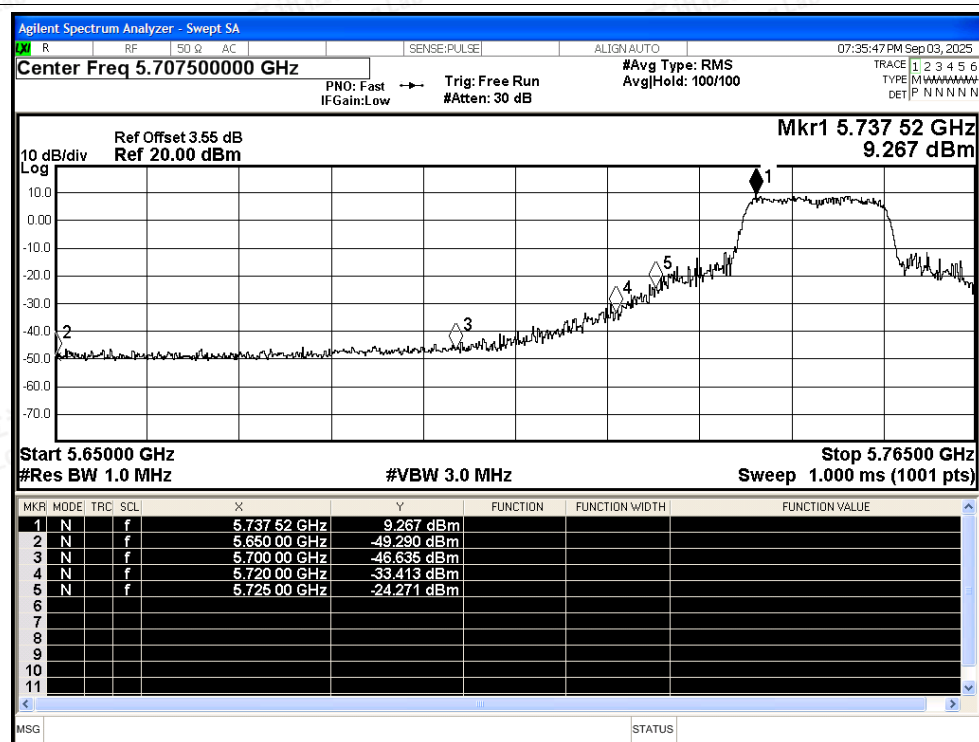

Restrict Band NVNT ac20 5745MHz Ant3 Average

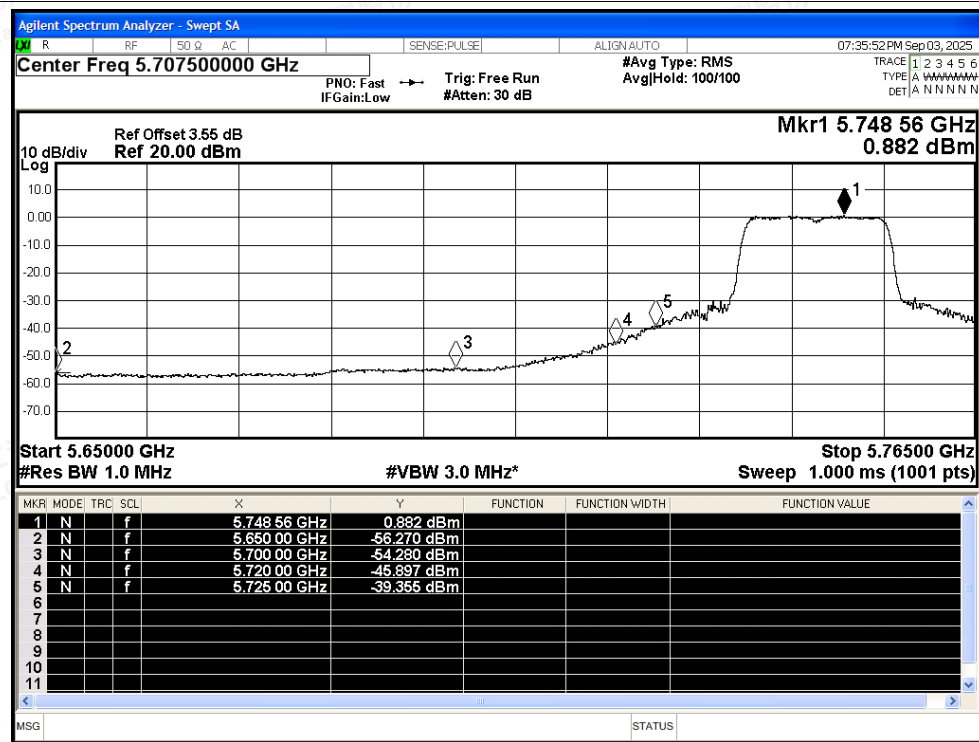

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant3 Peak

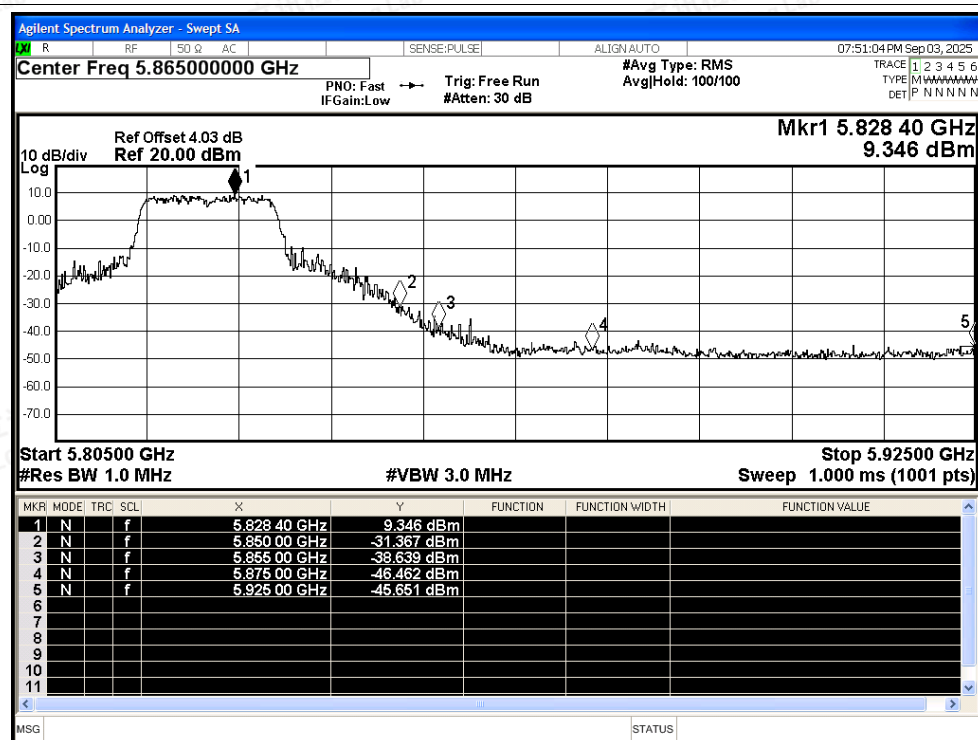

Restrict Band NVNT ac20 5825MHz Ant3 Average

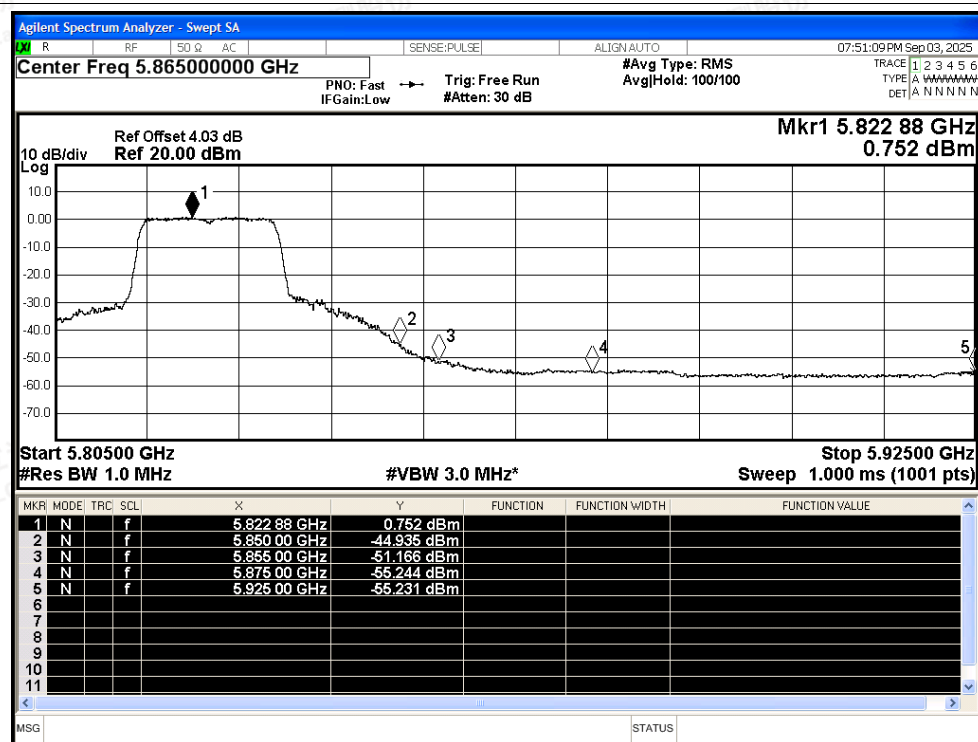

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant3 Peak

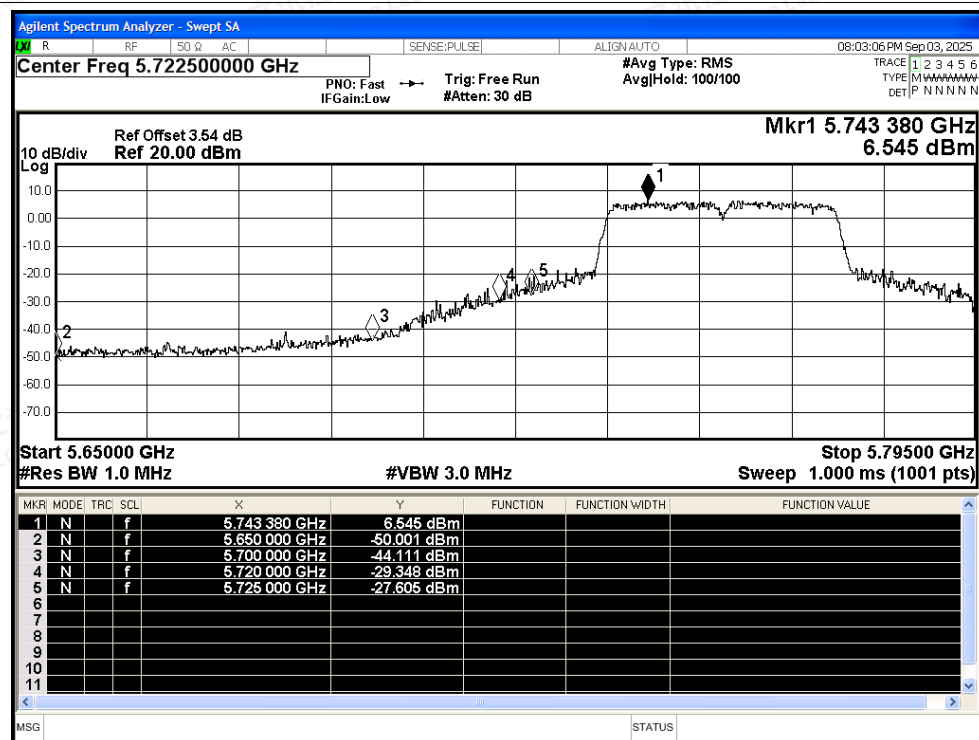

Restrict Band NVNT ac40 5755MHz Ant3 Average

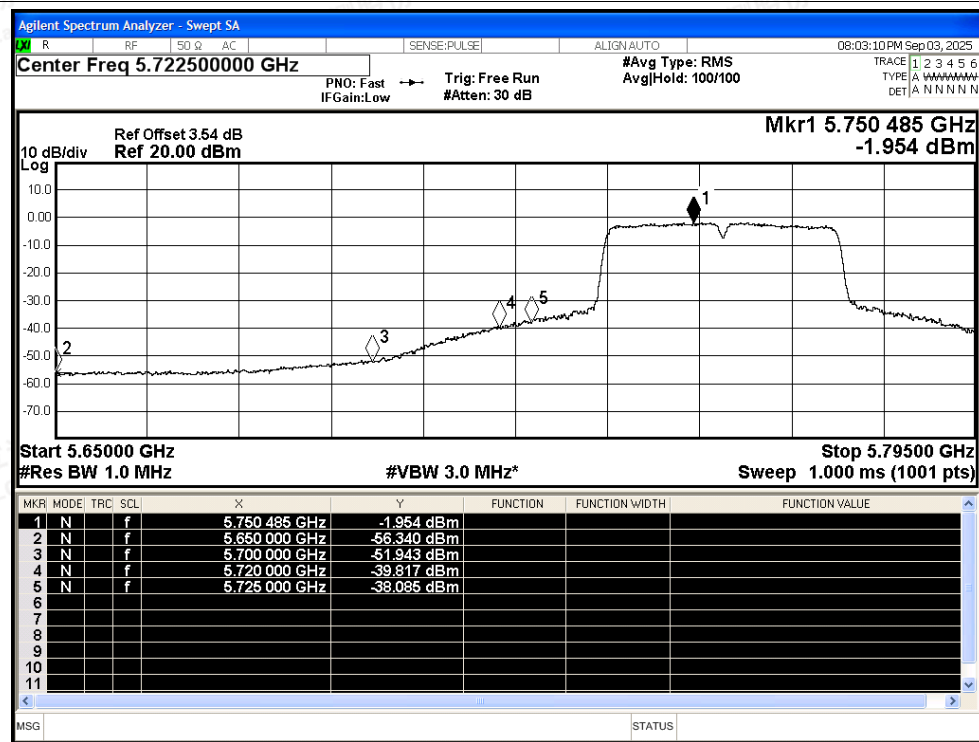

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant3 Peak

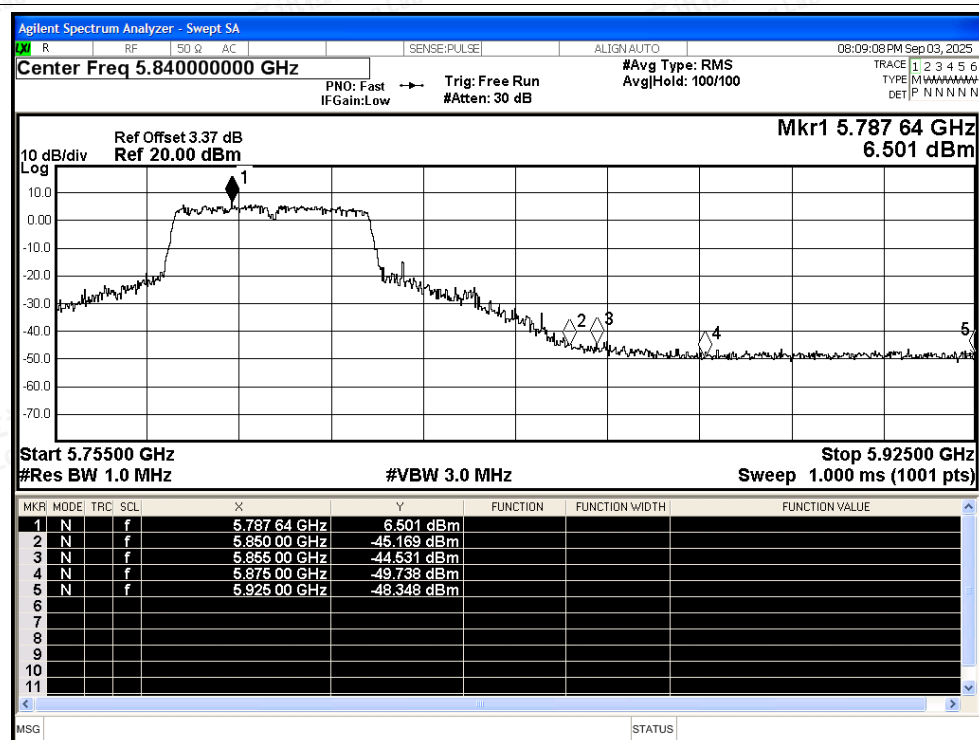

Restrict Band NVNT ac40 5795MHz Ant3 Average

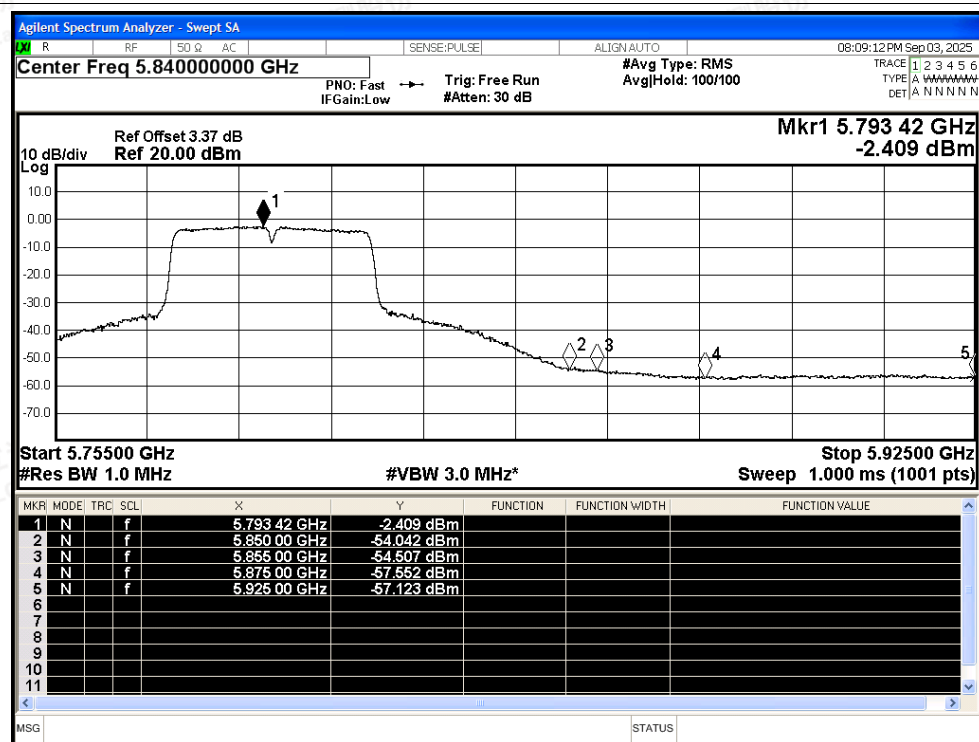

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant3 Peak

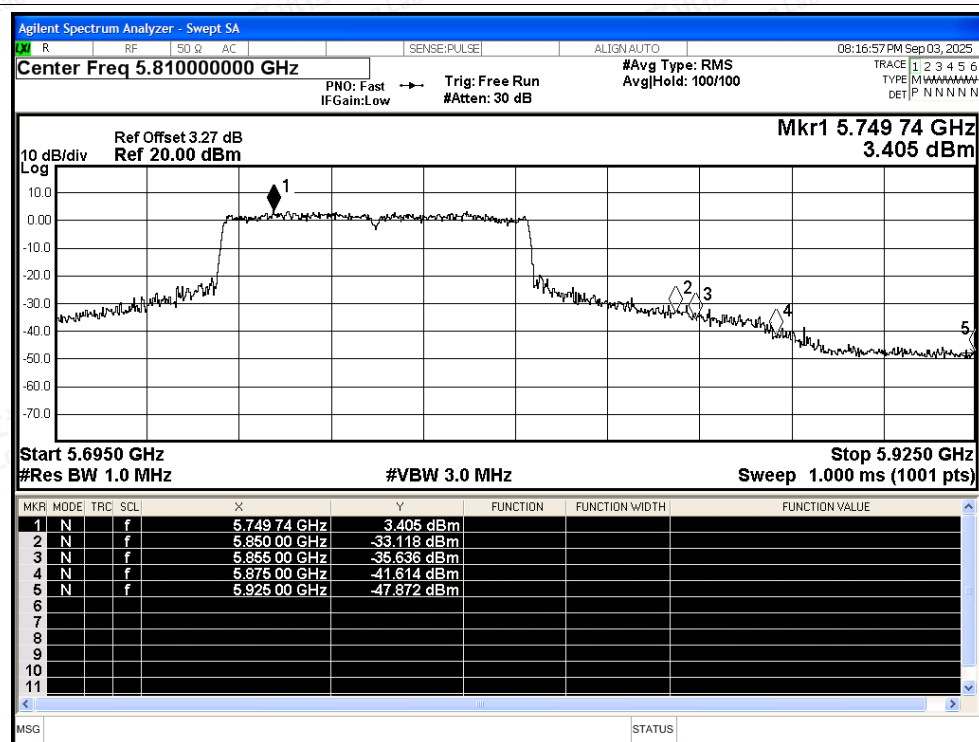


Restrict Band NVNT ac80 5775MHz Ant3 Average

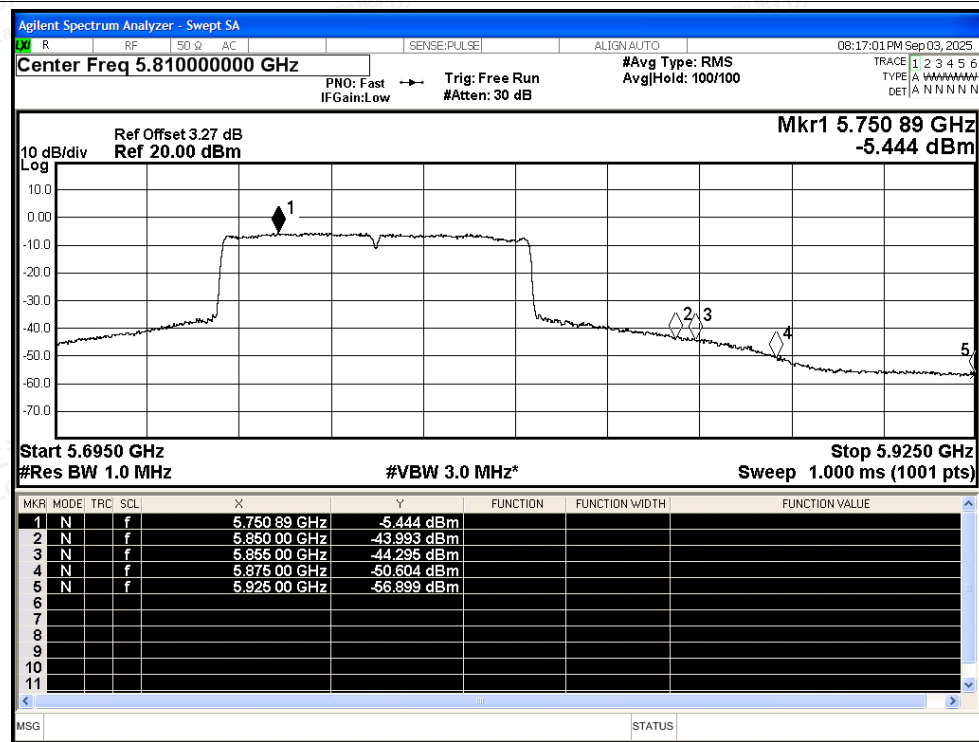




Restrict Band NVNT ac80 5775MHz Ant3 Peak

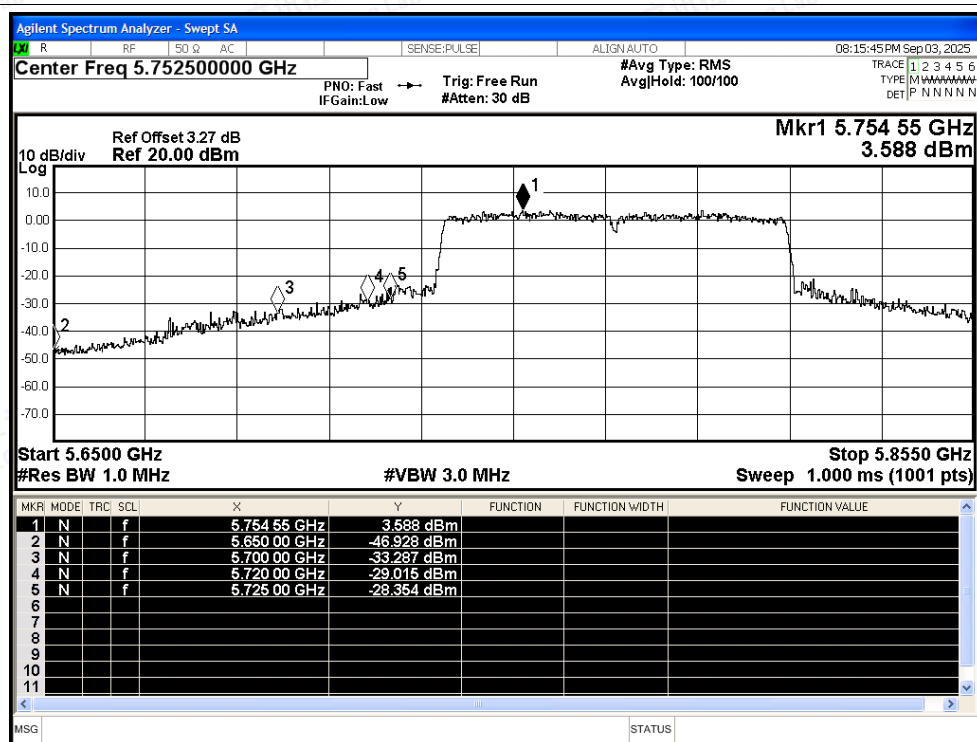

Restrict Band NVNT ac80 5775MHz Ant3 Average

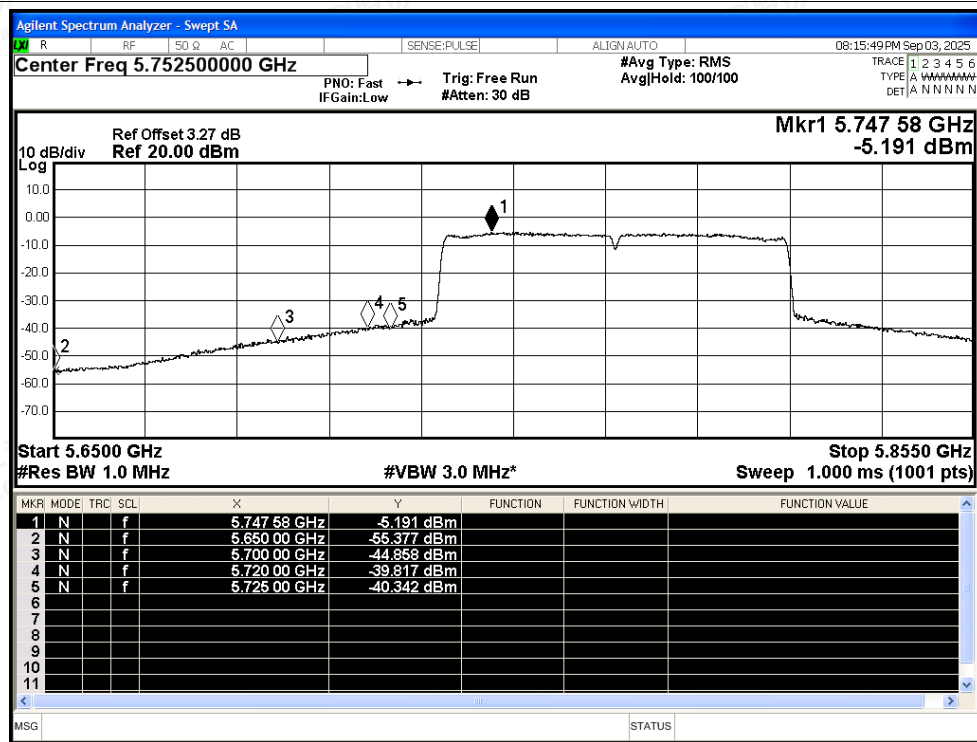

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant3 Peak

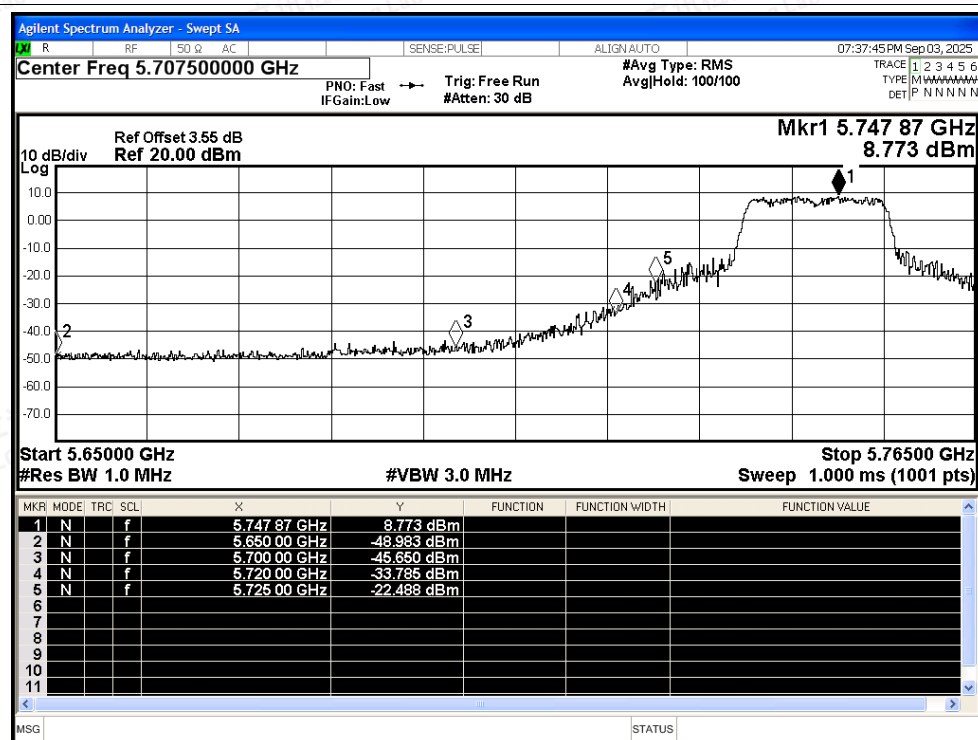

Restrict Band NVNT ax20 5745MHz Ant3 Average

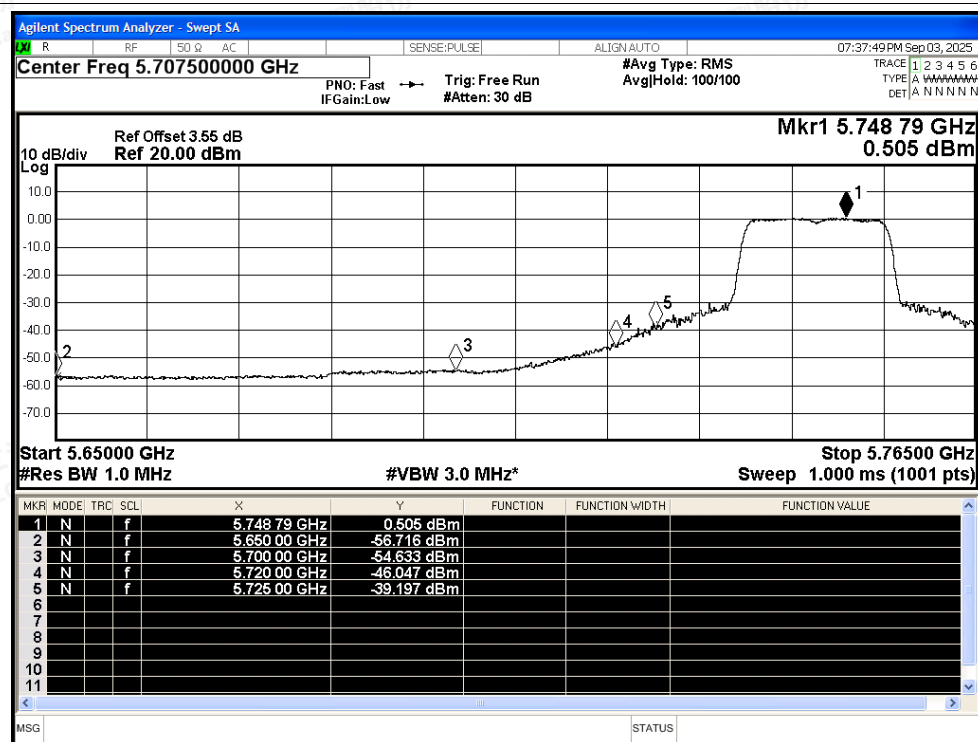

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant3 Peak

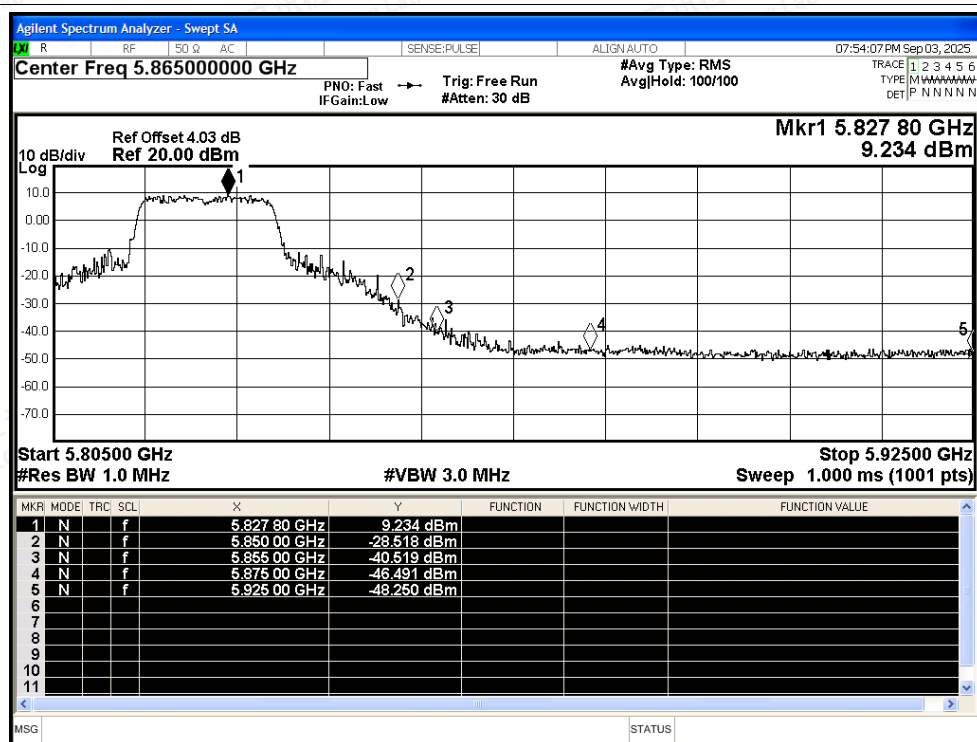

Restrict Band NVNT ax20 5825MHz Ant3 Average

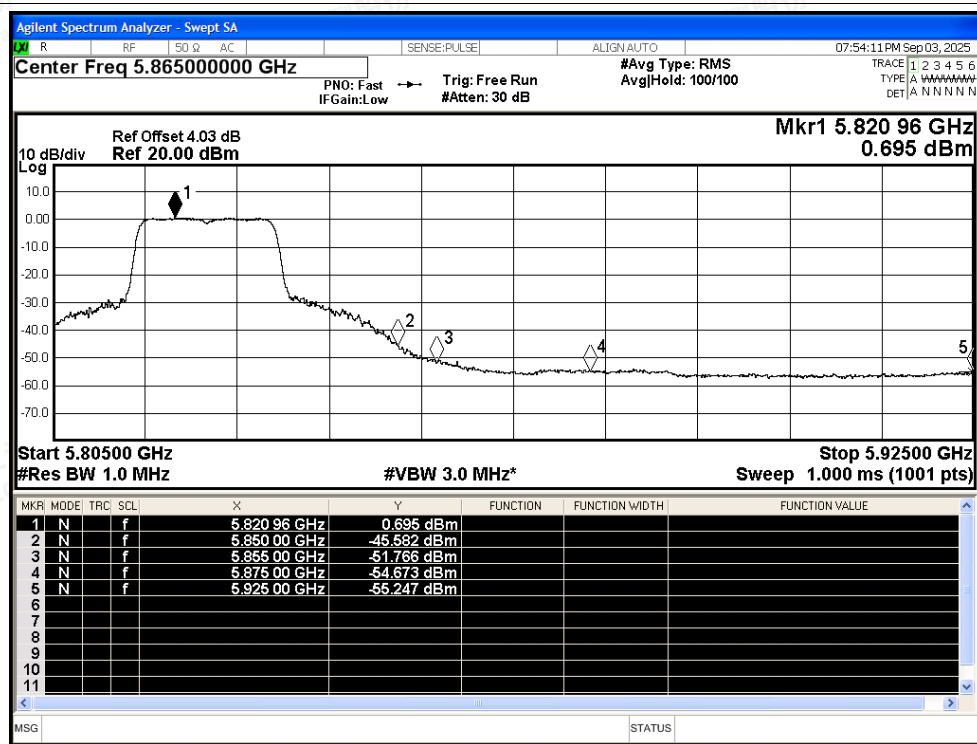

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant3 Peak

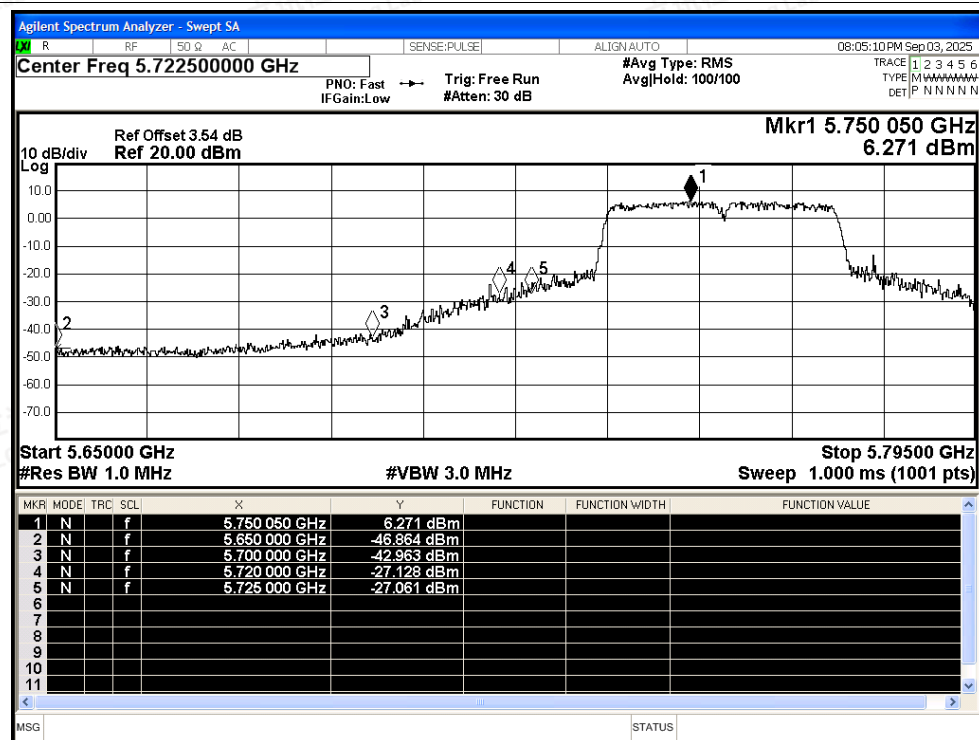

Restrict Band NVNT ax40 5755MHz Ant3 Average

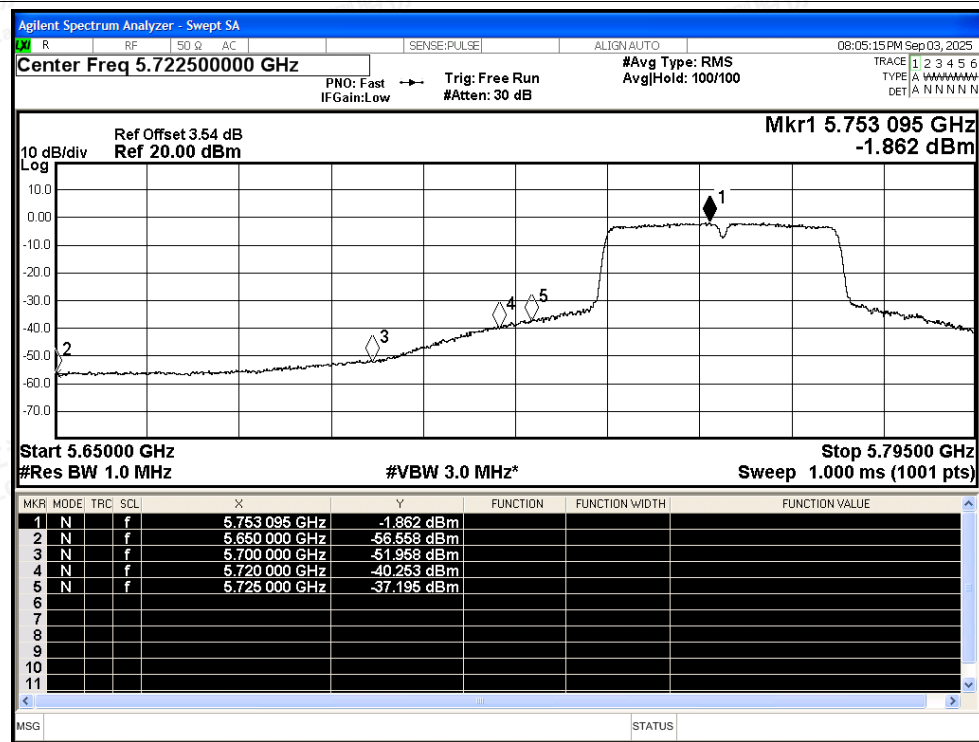

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant3 Peak

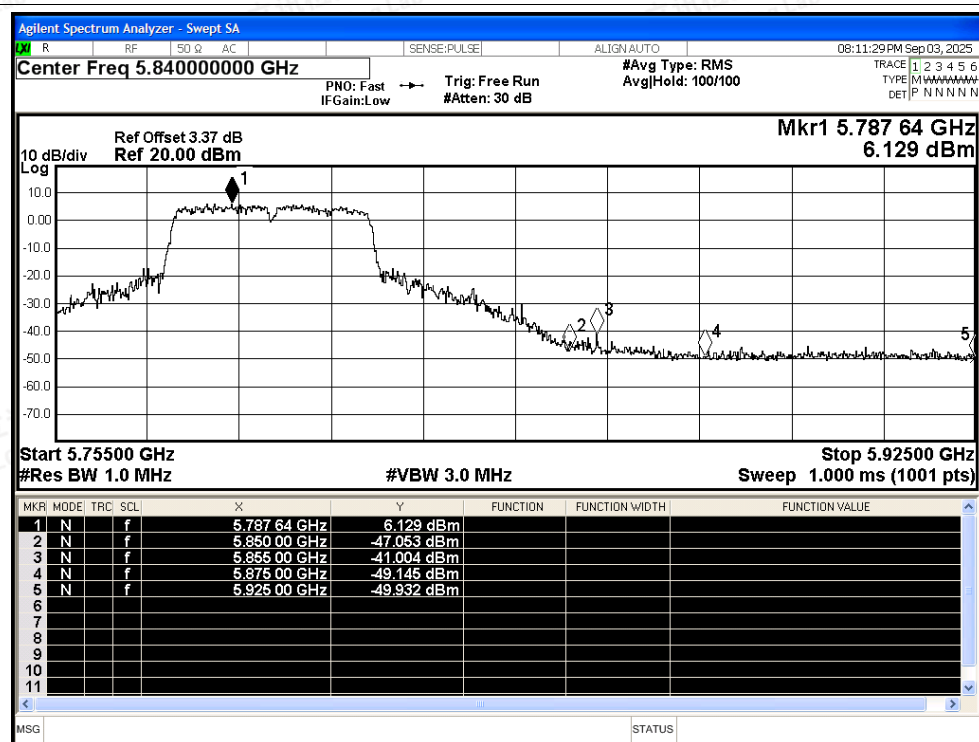

Restrict Band NVNT ax40 5795MHz Ant3 Average

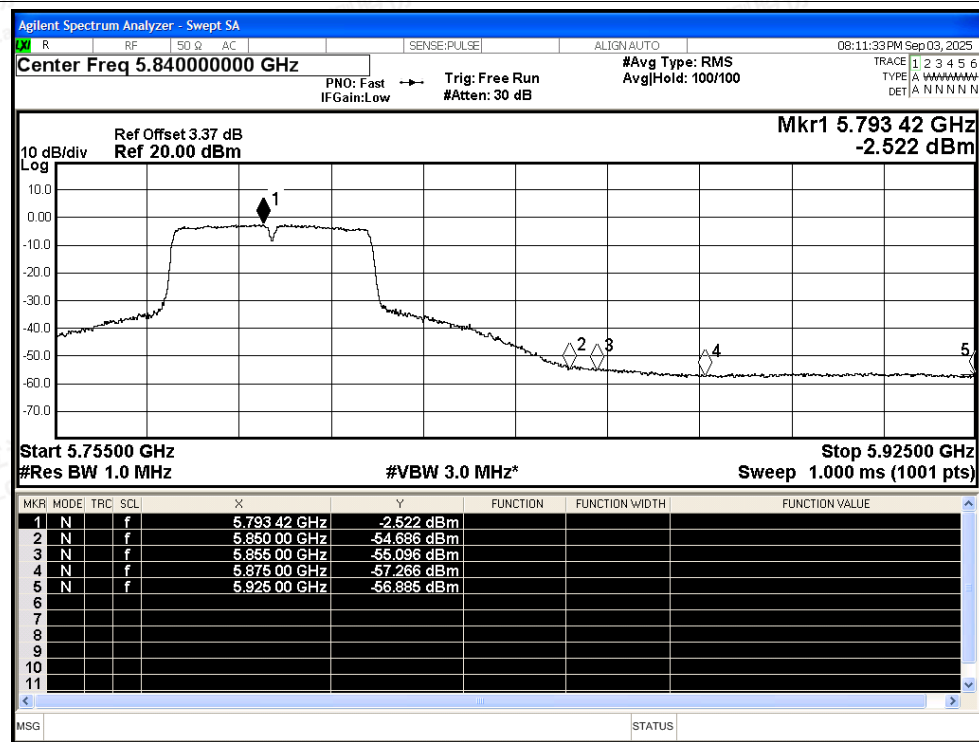

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant3 Peak

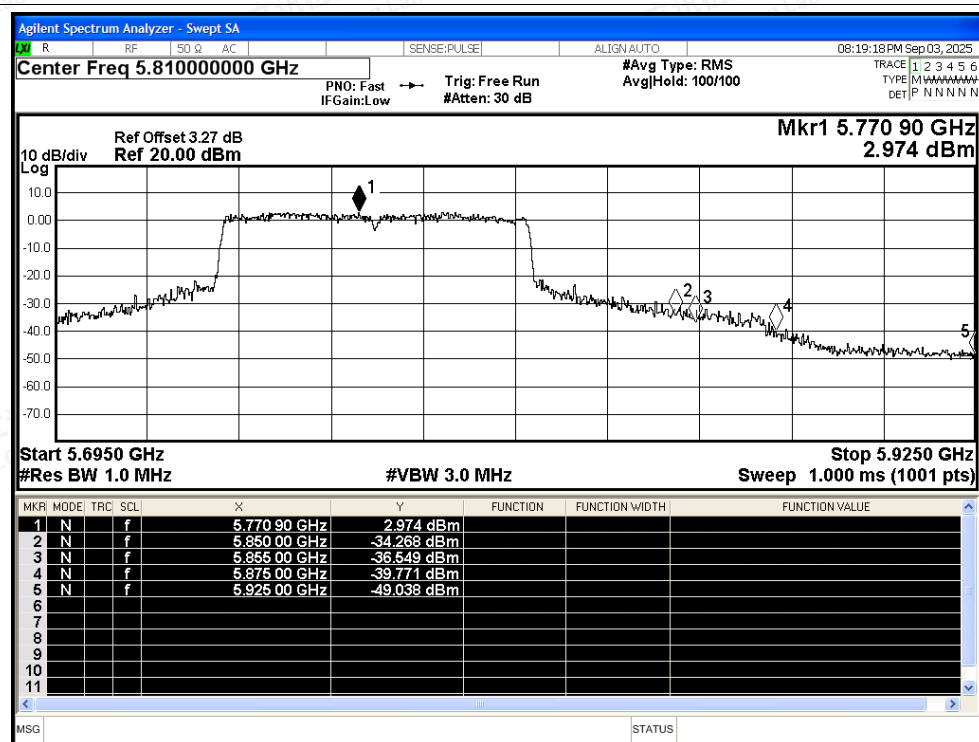

Restrict Band NVNT ax80 5775MHz Ant3 Average

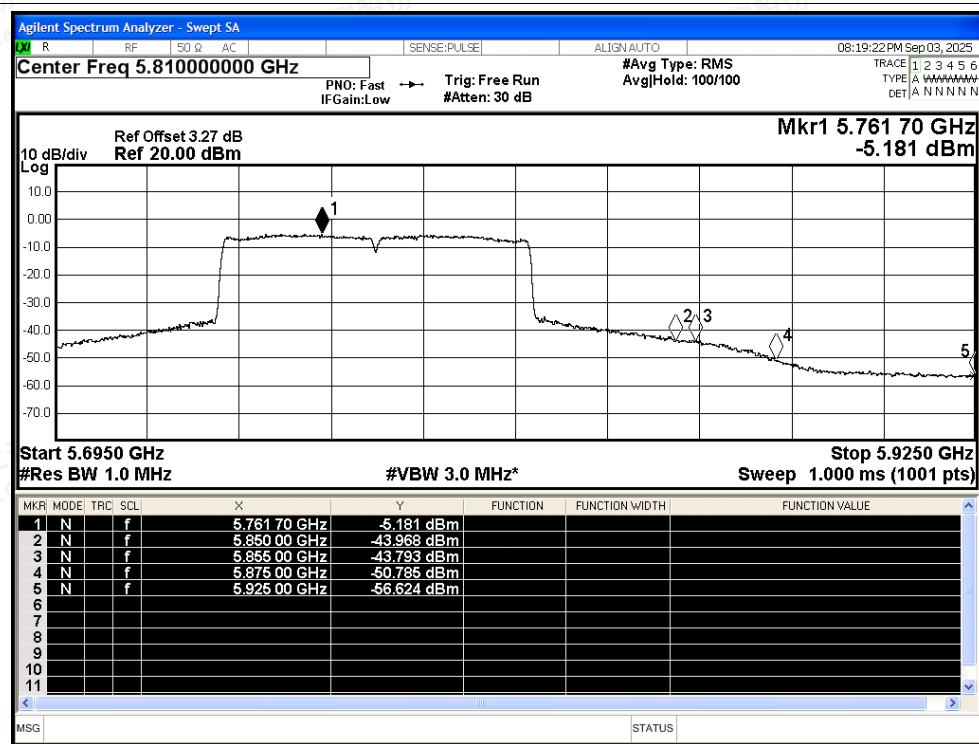

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant3 Peak

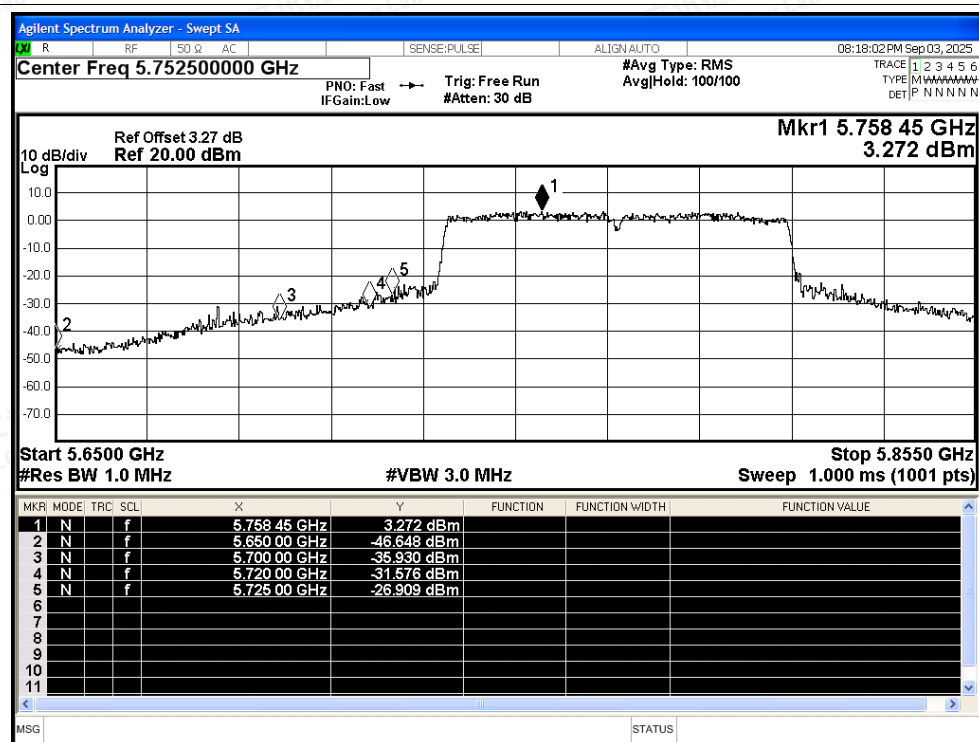


Restrict Band NVNT ax80 5775MHz Ant3 Average

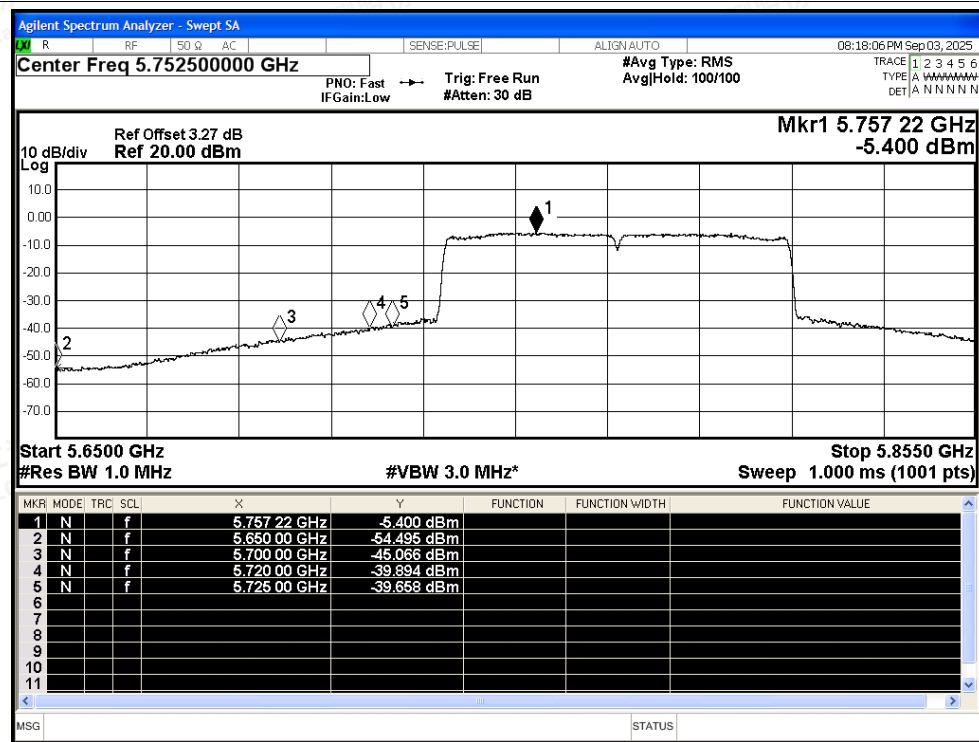




Restrict Band NVNT be20 5745MHz Ant3 Peak

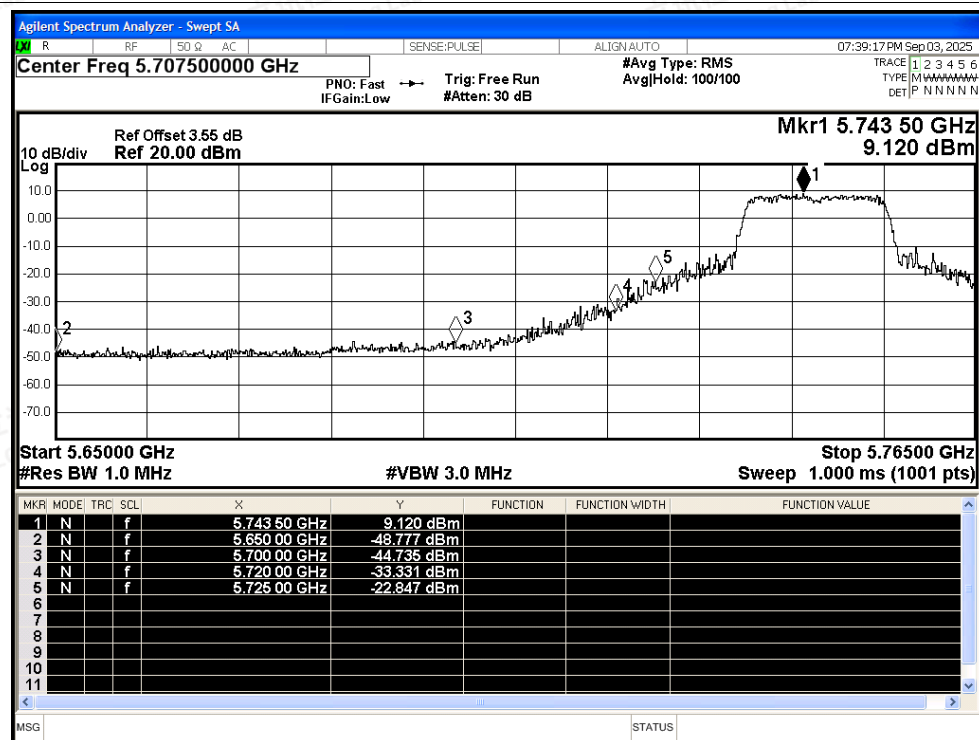

Restrict Band NVNT be20 5745MHz Ant3 Average

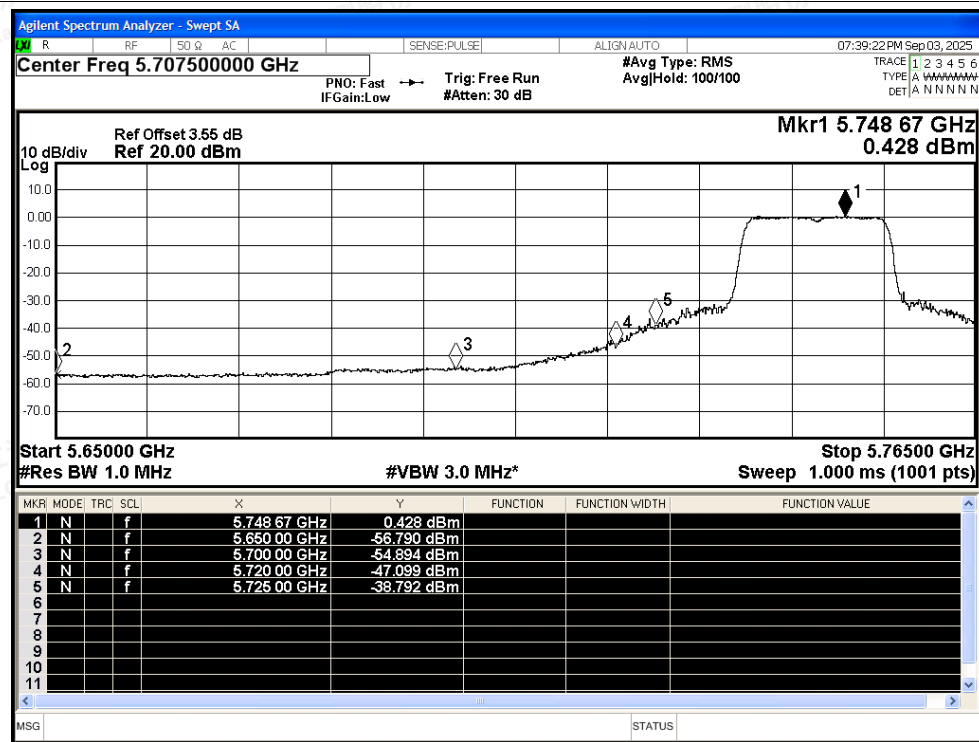

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5825MHz Ant3 Peak

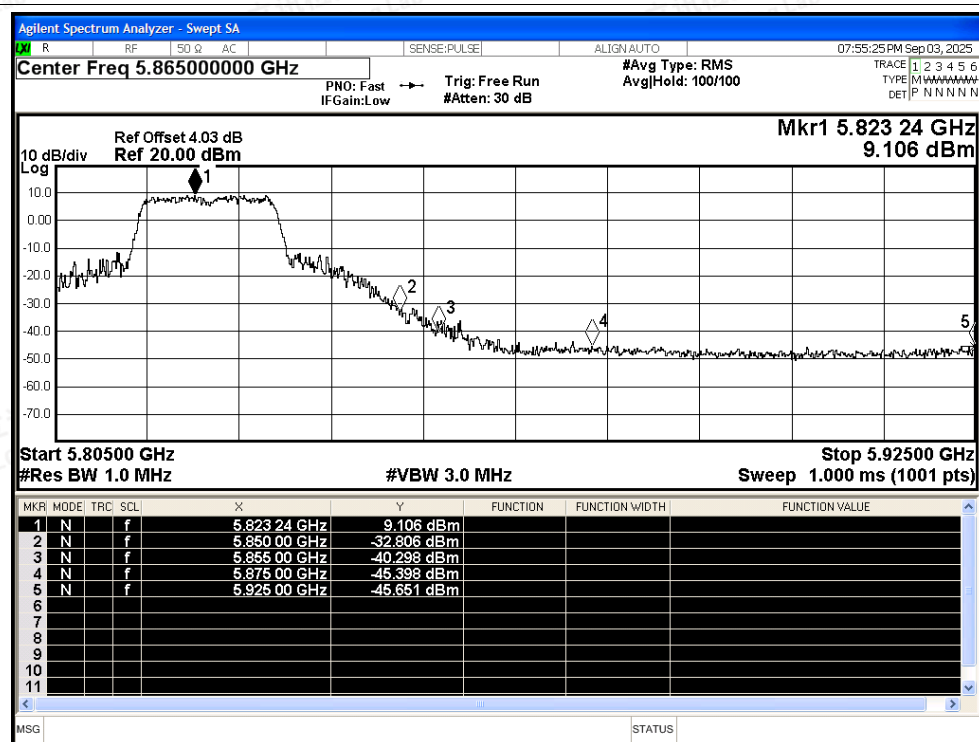

Restrict Band NVNT be20 5825MHz Ant3 Average

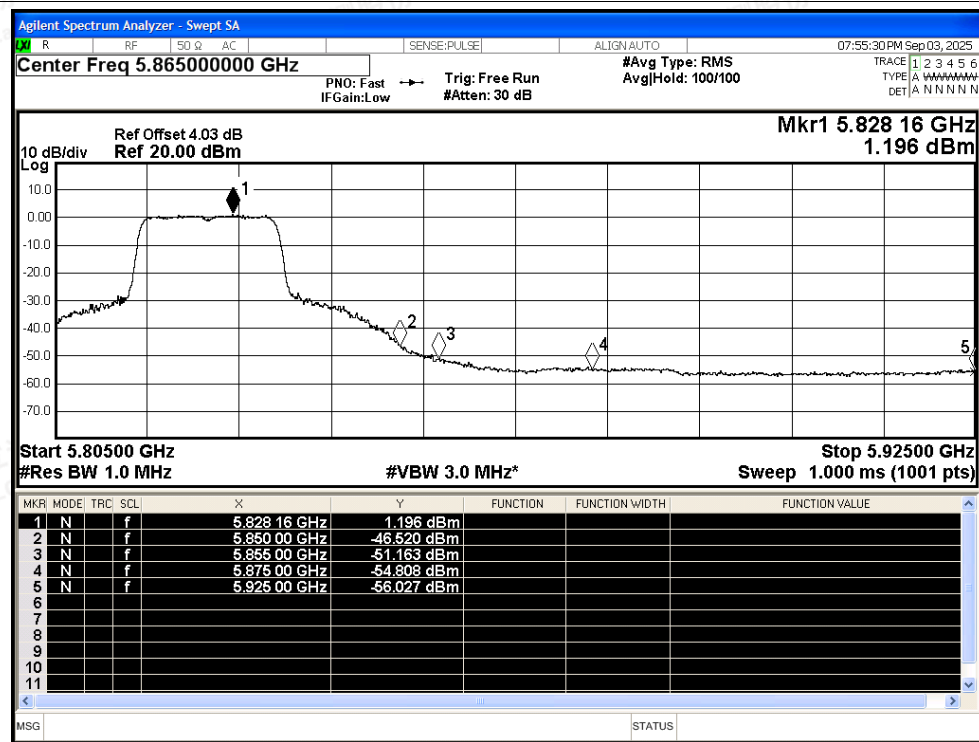

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5755MHz Ant3 Peak

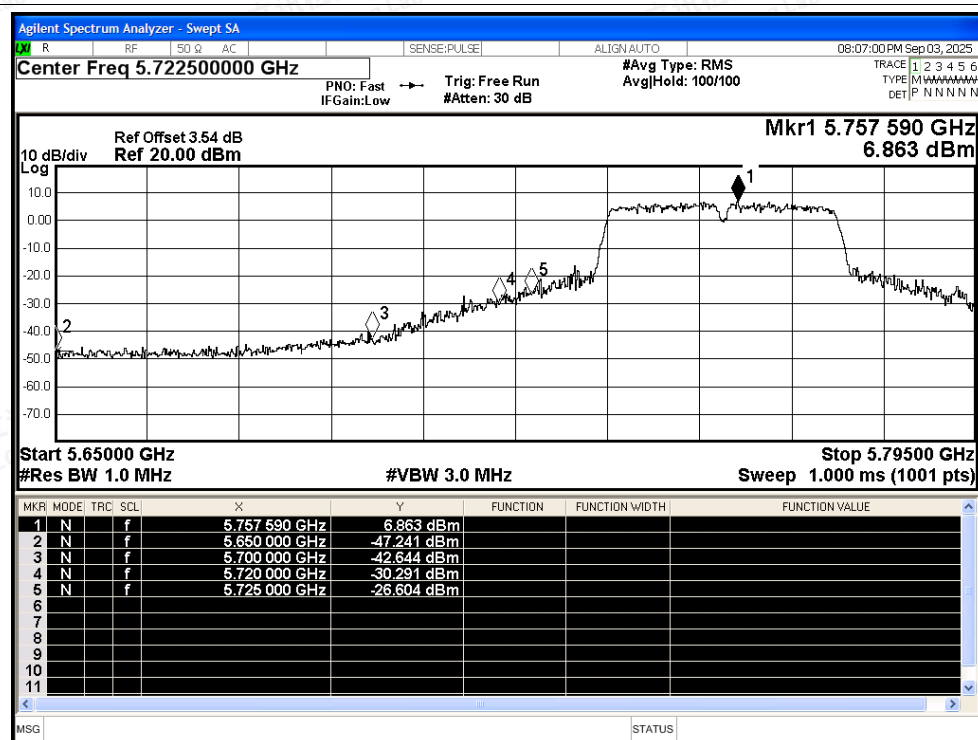

Restrict Band NVNT be40 5755MHz Ant3 Average

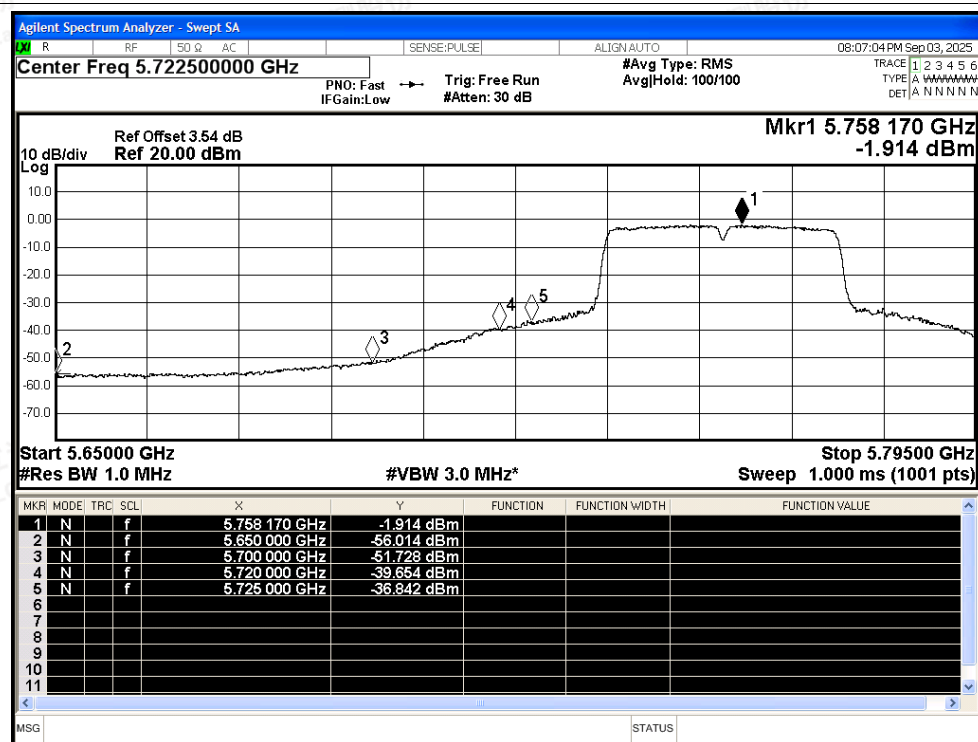

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5795MHz Ant3 Peak

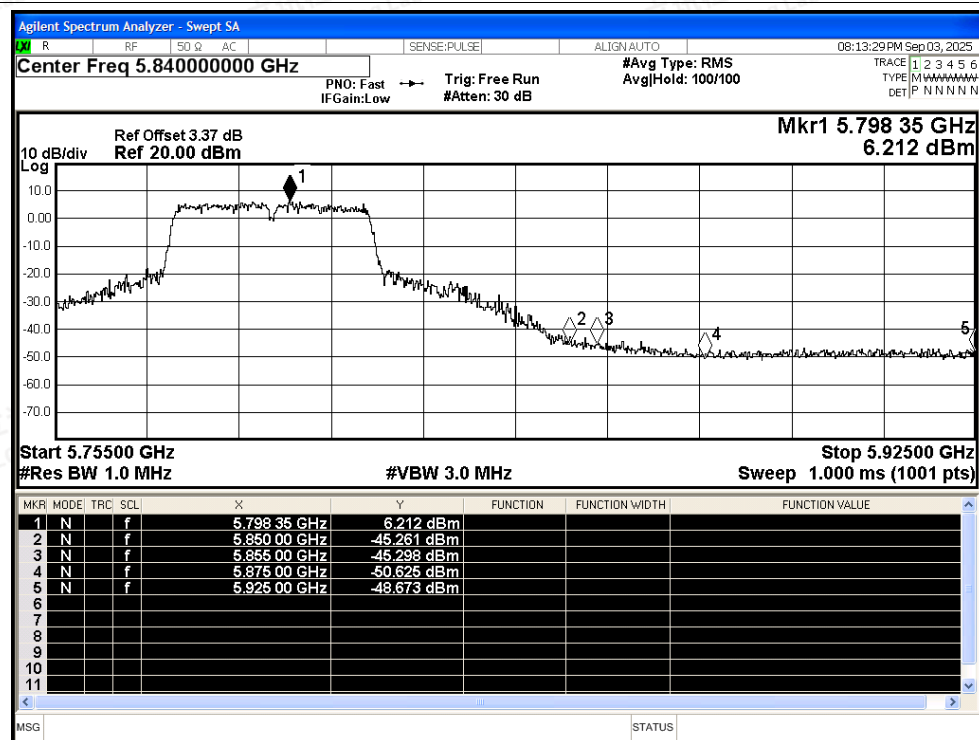

Restrict Band NVNT be40 5795MHz Ant3 Average

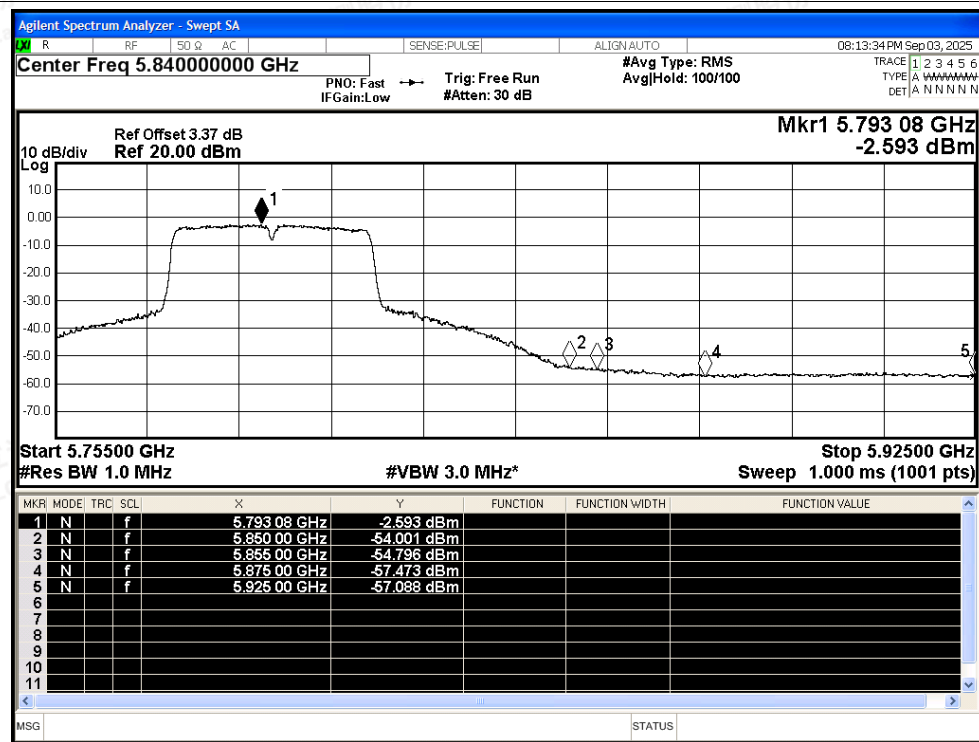

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5775MHz Ant3 Peak

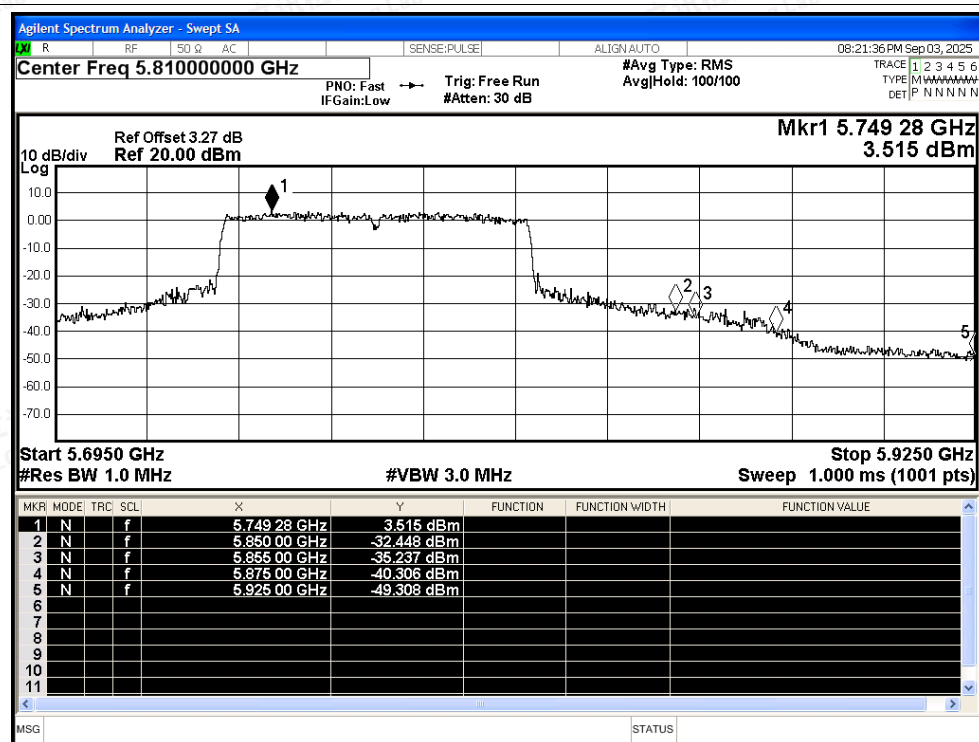

Restrict Band NVNT be80 5775MHz Ant3 Average

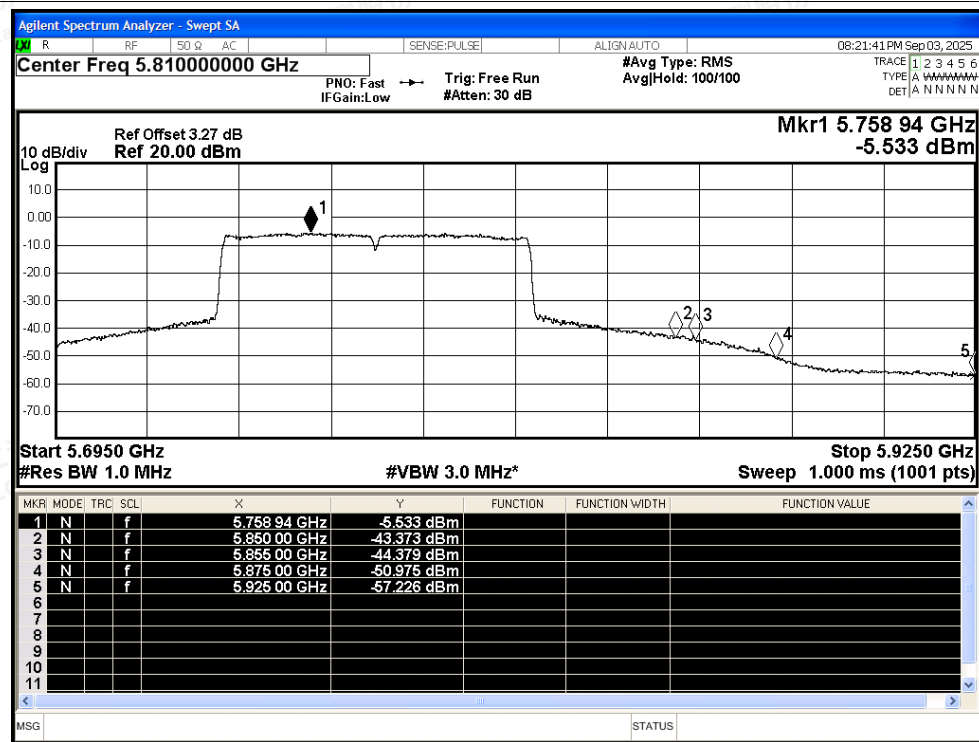

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5775MHz Ant3 Peak

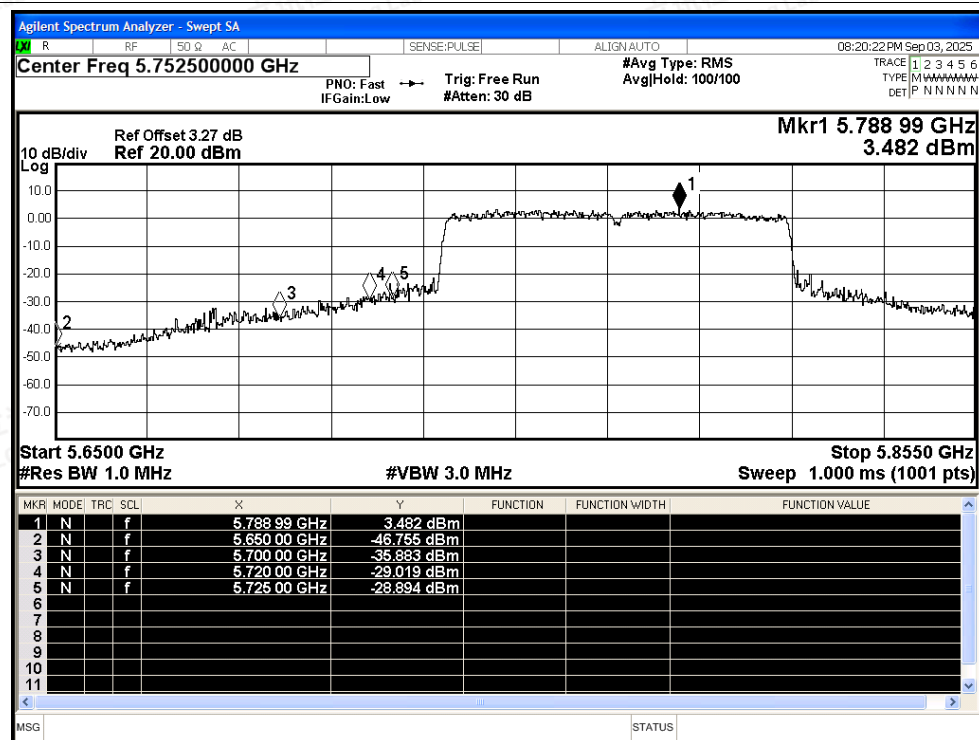

Restrict Band NVNT be80 5775MHz Ant3 Average

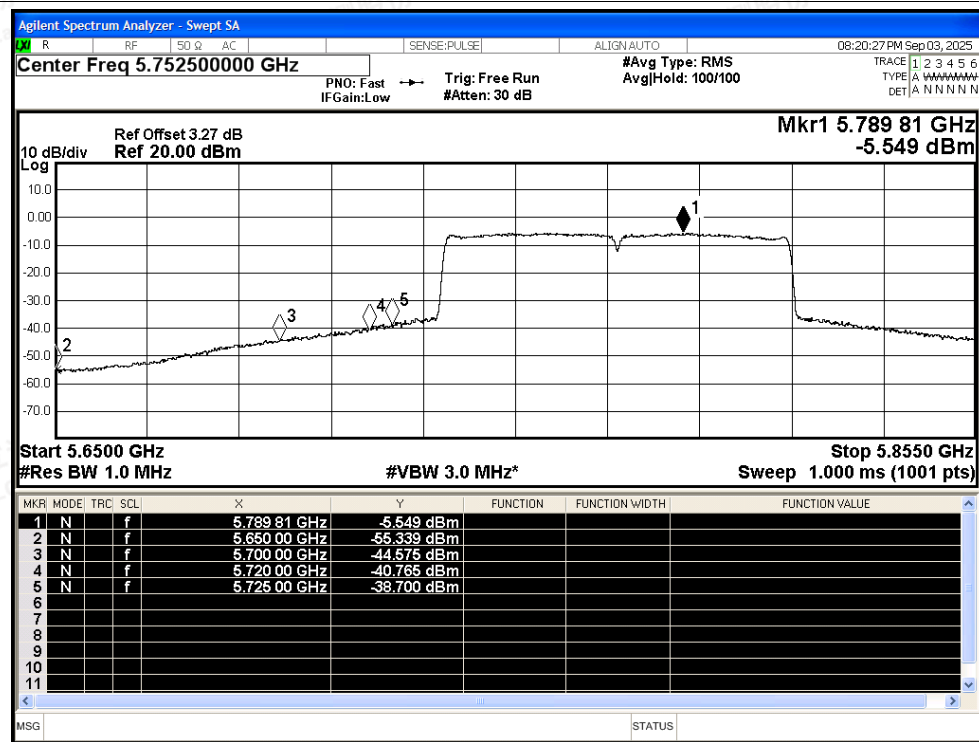



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant4	5650	-49.61	4.08	-	-45.53	Peak	-27	Pass
NVNT	a	5745	Ant4	5650	-56.8	4.08	0.24	-52.48	Average	-27	Pass
NVNT	a	5745	Ant4	5700	-46.35	4.08	-	-42.27	Peak	10	Pass
NVNT	a	5745	Ant4	5700	-55.2	4.08	0.24	-50.88	Average	10	Pass
NVNT	a	5745	Ant4	5720	-35.29	4.08	-	-31.21	Peak	15.6	Pass
NVNT	a	5745	Ant4	5720	-46.43	4.08	0.24	-42.11	Average	15.6	Pass
NVNT	a	5745	Ant4	5725	-24.25	4.08	-	-20.17	Peak	27	Pass
NVNT	a	5745	Ant4	5725	-39.15	4.08	0.24	-34.83	Average	27	Pass
NVNT	a	5825	Ant4	5850	-35.56	4.08	-	-31.48	Peak	27	Pass
NVNT	a	5825	Ant4	5850	-49.08	4.08	0.24	-44.76	Average	27	Pass
NVNT	a	5825	Ant4	5855	-43.04	4.08	-	-38.96	Peak	15.6	Pass
NVNT	a	5825	Ant4	5855	-52.27	4.08	0.24	-47.95	Average	15.6	Pass
NVNT	a	5825	Ant4	5875	-47.13	4.08	-	-43.05	Peak	10	Pass
NVNT	a	5825	Ant4	5875	-54.84	4.08	0.24	-50.52	Average	10	Pass
NVNT	a	5825	Ant4	5925	-45.64	4.08	-	-41.56	Peak	-27	Pass
NVNT	a	5825	Ant4	5925	-55.42	4.08	0.24	-51.10	Average	-27	Pass
NVNT	n20	5745	Ant4	5650	-47.95	4.08	-	-43.87	Peak	-27	Pass
NVNT	n20	5745	Ant4	5650	-56.9	4.08	0.12	-52.70	Average	-27	Pass
NVNT	n20	5745	Ant4	5700	-46.5	4.08	-	-42.42	Peak	10	Pass
NVNT	n20	5745	Ant4	5700	-54.47	4.08	0.12	-50.27	Average	10	Pass
NVNT	n20	5745	Ant4	5720	-32.4	4.08	-	-28.32	Peak	15.6	Pass
NVNT	n20	5745	Ant4	5720	-46.18	4.08	0.12	-41.98	Average	15.6	Pass
NVNT	n20	5745	Ant4	5725	-28.71	4.08	-	-24.63	Peak	27	Pass
NVNT	n20	5745	Ant4	5725	-38.17	4.08	0.12	-33.97	Average	27	Pass
NVNT	n20	5825	Ant4	5850	-33.8	4.08	-	-29.72	Peak	27	Pass
NVNT	n20	5825	Ant4	5850	-45.44	4.08	0.12	-41.24	Average	27	Pass
NVNT	n20	5825	Ant4	5855	-34.55	4.08	-	-30.47	Peak	15.6	Pass
NVNT	n20	5825	Ant4	5855	-50.47	4.08	0.12	-46.27	Average	15.6	Pass
NVNT	n20	5825	Ant4	5875	-45.92	4.08	-	-41.84	Peak	10	Pass
NVNT	n20	5825	Ant4	5875	-55	4.08	0.12	-50.80	Average	10	Pass
NVNT	n20	5825	Ant4	5925	-47.81	4.08	-	-43.73	Peak	-27	Pass
NVNT	n20	5825	Ant4	5925	-55.3	4.08	0.12	-51.10	Average	-27	Pass
NVNT	n40	5755	Ant4	5650	-47.71	4.08	-	-43.63	Peak	-27	Pass
NVNT	n40	5755	Ant4	5650	-56.96	4.08	0.24	-52.64	Average	-27	Pass
NVNT	n40	5755	Ant4	5700	-44.34	4.08	-	-40.26	Peak	10	Pass
NVNT	n40	5755	Ant4	5700	-53.13	4.08	0.24	-48.81	Average	10	Pass
NVNT	n40	5755	Ant4	5720	-26.07	4.08	-	-21.99	Peak	15.6	Pass





NVNT	n40	5755	Ant4	5720	-43.37	4.08	0.24	-39.05	Average	15.6	Pass
NVNT	n40	5755	Ant4	5725	-26.53	4.08	-	-22.45	Peak	27	Pass
NVNT	n40	5755	Ant4	5725	-39.32	4.08	0.24	-35.00	Average	27	Pass
NVNT	n40	5795	Ant4	5850	-46.39	4.08	-	-42.31	Peak	27	Pass
NVNT	n40	5795	Ant4	5850	-54.54	4.08	0.24	-50.22	Average	27	Pass
NVNT	n40	5795	Ant4	5855	-45.34	4.08	-	-41.26	Peak	15.6	Pass
NVNT	n40	5795	Ant4	5855	-55.34	4.08	0.24	-51.02	Average	15.6	Pass
NVNT	n40	5795	Ant4	5875	-48.22	4.08	-	-44.14	Peak	10	Pass
NVNT	n40	5795	Ant4	5875	-56.76	4.08	0.24	-52.44	Average	10	Pass
NVNT	n40	5795	Ant4	5925	-47.94	4.08	-	-43.86	Peak	-27	Pass
NVNT	n40	5795	Ant4	5925	-56.99	4.08	0.24	-52.67	Average	-27	Pass
NVNT	ac20	5745	Ant4	5650	-49.45	4.08	-	-45.37	Peak	-27	Pass
NVNT	ac20	5745	Ant4	5650	-56.41	4.08	0.12	-52.21	Average	-27	Pass
NVNT	ac20	5745	Ant4	5700	-45.25	4.08	-	-41.17	Peak	10	Pass
NVNT	ac20	5745	Ant4	5700	-55.03	4.08	0.12	-50.83	Average	10	Pass
NVNT	ac20	5745	Ant4	5720	-32.47	4.08	-	-28.39	Peak	15.6	Pass
NVNT	ac20	5745	Ant4	5720	-45.57	4.08	0.12	-41.37	Average	15.6	Pass
NVNT	ac20	5745	Ant4	5725	-23.54	4.08	-	-19.46	Peak	27	Pass
NVNT	ac20	5745	Ant4	5725	-38.76	4.08	0.12	-34.56	Average	27	Pass
NVNT	ac20	5825	Ant4	5850	-34.95	4.08	-	-30.87	Peak	27	Pass
NVNT	ac20	5825	Ant4	5850	-46.94	4.08	0.12	-42.74	Average	27	Pass
NVNT	ac20	5825	Ant4	5855	-40	4.08	-	-35.92	Peak	15.6	Pass
NVNT	ac20	5825	Ant4	5855	-51.45	4.08	0.12	-47.25	Average	15.6	Pass
NVNT	ac20	5825	Ant4	5875	-46.44	4.08	-	-42.36	Peak	10	Pass
NVNT	ac20	5825	Ant4	5875	-55.62	4.08	0.12	-51.42	Average	10	Pass
NVNT	ac20	5825	Ant4	5925	-46.66	4.08	-	-42.58	Peak	-27	Pass
NVNT	ac20	5825	Ant4	5925	-55.88	4.08	0.12	-51.68	Average	-27	Pass
NVNT	ac40	5755	Ant4	5650	-49.83	4.08	-	-45.75	Peak	-27	Pass
NVNT	ac40	5755	Ant4	5650	-56.58	4.08	0.24	-52.26	Average	-27	Pass
NVNT	ac40	5755	Ant4	5700	-43.41	4.08	-	-39.33	Peak	10	Pass
NVNT	ac40	5755	Ant4	5700	-53.38	4.08	0.24	-49.06	Average	10	Pass
NVNT	ac40	5755	Ant4	5720	-29.7	4.08	-	-25.62	Peak	15.6	Pass
NVNT	ac40	5755	Ant4	5720	-42.8	4.08	0.24	-38.48	Average	15.6	Pass
NVNT	ac40	5755	Ant4	5725	-29.52	4.08	-	-25.44	Peak	27	Pass
NVNT	ac40	5755	Ant4	5725	-40.96	4.08	0.24	-36.64	Average	27	Pass
NVNT	ac40	5795	Ant4	5850	-45.66	4.08	-	-41.58	Peak	27	Pass
NVNT	ac40	5795	Ant4	5850	-53.93	4.08	0.23	-49.62	Average	27	Pass
NVNT	ac40	5795	Ant4	5855	-45.73	4.08	-	-41.65	Peak	15.6	Pass
NVNT	ac40	5795	Ant4	5855	-54.55	4.08	0.23	-50.24	Average	15.6	Pass
NVNT	ac40	5795	Ant4	5875	-49.08	4.08	-	-45.00	Peak	10	Pass
NVNT	ac40	5795	Ant4	5875	-56.84	4.08	0.23	-52.53	Average	10	Pass





NVNT	ac40	5795	Ant4	5925	-49.85	4.08	-	-45.77	Peak	-27	Pass
NVNT	ac40	5795	Ant4	5925	-57.42	4.08	0.23	-53.11	Average	-27	Pass
NVNT	ac80	5775	Ant4	5850	-33.79	4.08	-	-29.71	Peak	27	Pass
NVNT	ac80	5775	Ant4	5850	-43.76	4.08	0.47	-39.21	Average	27	Pass
NVNT	ac80	5775	Ant4	5855	-34.44	4.08	-	-30.36	Peak	15.6	Pass
NVNT	ac80	5775	Ant4	5855	-44.7	4.08	0.47	-40.15	Average	15.6	Pass
NVNT	ac80	5775	Ant4	5875	-37.25	4.08	-	-33.17	Peak	10	Pass
NVNT	ac80	5775	Ant4	5875	-50.31	4.08	0.47	-45.76	Average	10	Pass
NVNT	ac80	5775	Ant4	5925	-47.17	4.08	-	-43.09	Peak	-27	Pass
NVNT	ac80	5775	Ant4	5925	-56.93	4.08	0.47	-52.38	Average	-27	Pass
NVNT	ac80	5775	Ant4	5650	-45.94	4.08	-	-41.86	Peak	-27	Pass
NVNT	ac80	5775	Ant4	5650	-55.57	4.08	0.47	-51.02	Average	-27	Pass
NVNT	ac80	5775	Ant4	5700	-34.44	4.08	-	-30.36	Peak	10	Pass
NVNT	ac80	5775	Ant4	5700	-44.38	4.08	0.47	-39.83	Average	10	Pass
NVNT	ac80	5775	Ant4	5720	-27.1	4.08	-	-23.02	Peak	15.6	Pass
NVNT	ac80	5775	Ant4	5720	-39.99	4.08	0.47	-35.44	Average	15.6	Pass
NVNT	ac80	5775	Ant4	5725	-28.7	4.08	-	-24.62	Peak	27	Pass
NVNT	ac80	5775	Ant4	5725	-39.4	4.08	0.47	-34.85	Average	27	Pass
NVNT	ax20	5745	Ant4	5650	-50.13	4.08	-	-46.05	Peak	-27	Pass
NVNT	ax20	5745	Ant4	5650	-56.64	4.08	0.12	-52.44	Average	-27	Pass
NVNT	ax20	5745	Ant4	5700	-45.38	4.08	-	-41.30	Peak	10	Pass
NVNT	ax20	5745	Ant4	5700	-54.86	4.08	0.12	-50.66	Average	10	Pass
NVNT	ax20	5745	Ant4	5720	-33.75	4.08	-	-29.67	Peak	15.6	Pass
NVNT	ax20	5745	Ant4	5720	-45.81	4.08	0.12	-41.61	Average	15.6	Pass
NVNT	ax20	5745	Ant4	5725	-23.42	4.08	-	-19.34	Peak	27	Pass
NVNT	ax20	5745	Ant4	5725	-36.91	4.08	0.12	-32.71	Average	27	Pass
NVNT	ax20	5825	Ant4	5850	-36.67	4.08	-	-32.59	Peak	27	Pass
NVNT	ax20	5825	Ant4	5850	-46.23	4.08	0.12	-42.03	Average	27	Pass
NVNT	ax20	5825	Ant4	5855	-41.04	4.08	-	-36.96	Peak	15.6	Pass
NVNT	ax20	5825	Ant4	5855	-51.46	4.08	0.12	-47.26	Average	15.6	Pass
NVNT	ax20	5825	Ant4	5875	-47.17	4.08	-	-43.09	Peak	10	Pass
NVNT	ax20	5825	Ant4	5875	-55.19	4.08	0.12	-50.99	Average	10	Pass
NVNT	ax20	5825	Ant4	5925	-48.29	4.08	-	-44.21	Peak	-27	Pass
NVNT	ax20	5825	Ant4	5925	-55.43	4.08	0.12	-51.23	Average	-27	Pass
NVNT	ax40	5755	Ant4	5650	-47.82	4.08	-	-43.74	Peak	-27	Pass
NVNT	ax40	5755	Ant4	5650	-56.62	4.08	0.24	-52.30	Average	-27	Pass
NVNT	ax40	5755	Ant4	5700	-45.12	4.08	-	-41.04	Peak	10	Pass
NVNT	ax40	5755	Ant4	5700	-53.15	4.08	0.24	-48.83	Average	10	Pass
NVNT	ax40	5755	Ant4	5720	-31.74	4.08	-	-27.66	Peak	15.6	Pass
NVNT	ax40	5755	Ant4	5720	-42.27	4.08	0.24	-37.95	Average	15.6	Pass
NVNT	ax40	5755	Ant4	5725	-27.8	4.08	-	-23.72	Peak	27	Pass





NVNT	ax40	5755	Ant4	5725	-39.87	4.08	0.24	-35.55	Average	27	Pass
NVNT	ax40	5795	Ant4	5850	-43.65	4.08	-	-39.57	Peak	27	Pass
NVNT	ax40	5795	Ant4	5850	-54.35	4.08	0.23	-50.04	Average	27	Pass
NVNT	ax40	5795	Ant4	5855	-45.38	4.08	-	-41.30	Peak	15.6	Pass
NVNT	ax40	5795	Ant4	5855	-55.55	4.08	0.23	-51.24	Average	15.6	Pass
NVNT	ax40	5795	Ant4	5875	-48.84	4.08	-	-44.76	Peak	10	Pass
NVNT	ax40	5795	Ant4	5875	-57.53	4.08	0.23	-53.22	Average	10	Pass
NVNT	ax40	5795	Ant4	5925	-48.59	4.08	-	-44.51	Peak	-27	Pass
NVNT	ax40	5795	Ant4	5925	-57.73	4.08	0.23	-53.42	Average	-27	Pass
NVNT	ax80	5775	Ant4	5850	-32.61	4.08	-	-28.53	Peak	27	Pass
NVNT	ax80	5775	Ant4	5850	-43.56	4.08	0.47	-39.01	Average	27	Pass
NVNT	ax80	5775	Ant4	5855	-32.59	4.08	-	-28.51	Peak	15.6	Pass
NVNT	ax80	5775	Ant4	5855	-44.5	4.08	0.47	-39.95	Average	15.6	Pass
NVNT	ax80	5775	Ant4	5875	-42.73	4.08	-	-38.65	Peak	10	Pass
NVNT	ax80	5775	Ant4	5875	-50.87	4.08	0.47	-46.32	Average	10	Pass
NVNT	ax80	5775	Ant4	5925	-48.37	4.08	-	-44.29	Peak	-27	Pass
NVNT	ax80	5775	Ant4	5925	-56.85	4.08	0.47	-52.30	Average	-27	Pass
NVNT	ax80	5775	Ant4	5650	-47.65	4.08	-	-43.57	Peak	-27	Pass
NVNT	ax80	5775	Ant4	5650	-55.58	4.08	0.47	-51.03	Average	-27	Pass
NVNT	ax80	5775	Ant4	5700	-35.3	4.08	-	-31.22	Peak	10	Pass
NVNT	ax80	5775	Ant4	5700	-45.13	4.08	0.47	-40.58	Average	10	Pass
NVNT	ax80	5775	Ant4	5720	-29.65	4.08	-	-25.57	Peak	15.6	Pass
NVNT	ax80	5775	Ant4	5720	-40.51	4.08	0.47	-35.96	Average	15.6	Pass
NVNT	ax80	5775	Ant4	5725	-24.47	4.08	-	-20.39	Peak	27	Pass
NVNT	ax80	5775	Ant4	5725	-38.73	4.08	0.47	-34.18	Average	27	Pass
NVNT	be20	5745	Ant4	5650	-49.03	4.08	-	-44.95	Peak	-27	Pass
NVNT	be20	5745	Ant4	5650	-56.41	4.08	0.12	-52.21	Average	-27	Pass
NVNT	be20	5745	Ant4	5700	-46.45	4.08	-	-42.37	Peak	10	Pass
NVNT	be20	5745	Ant4	5700	-55.34	4.08	0.12	-51.14	Average	10	Pass
NVNT	be20	5745	Ant4	5720	-28.03	4.08	-	-23.95	Peak	15.6	Pass
NVNT	be20	5745	Ant4	5720	-44.51	4.08	0.12	-40.31	Average	15.6	Pass
NVNT	be20	5745	Ant4	5725	-27.27	4.08	-	-23.19	Peak	27	Pass
NVNT	be20	5745	Ant4	5725	-39.35	4.08	0.12	-35.15	Average	27	Pass
NVNT	be20	5825	Ant4	5850	-31.8	4.08	-	-27.72	Peak	27	Pass
NVNT	be20	5825	Ant4	5850	-47.34	4.08	0.12	-43.14	Average	27	Pass
NVNT	be20	5825	Ant4	5855	-38.09	4.08	-	-34.01	Peak	15.6	Pass
NVNT	be20	5825	Ant4	5855	-51.41	4.08	0.12	-47.21	Average	15.6	Pass
NVNT	be20	5825	Ant4	5875	-48.61	4.08	-	-44.53	Peak	10	Pass
NVNT	be20	5825	Ant4	5875	-55.12	4.08	0.12	-50.92	Average	10	Pass
NVNT	be20	5825	Ant4	5925	-47.63	4.08	-	-43.55	Peak	-27	Pass
NVNT	be20	5825	Ant4	5925	-55.46	4.08	0.12	-51.26	Average	-27	Pass






NVNT	be40	5755	Ant4	5650	-49.21	4.08	-	-45.13	Peak	-27	Pass
NVNT	be40	5755	Ant4	5650	-57	4.08	0.24	-52.68	Average	-27	Pass
NVNT	be40	5755	Ant4	5700	-45.38	4.08	-	-41.30	Peak	10	Pass
NVNT	be40	5755	Ant4	5700	-53.56	4.08	0.24	-49.24	Average	10	Pass
NVNT	be40	5755	Ant4	5720	-29.24	4.08	-	-25.16	Peak	15.6	Pass
NVNT	be40	5755	Ant4	5720	-42.81	4.08	0.24	-38.49	Average	15.6	Pass
NVNT	be40	5755	Ant4	5725	-28.3	4.08	-	-24.22	Peak	27	Pass
NVNT	be40	5755	Ant4	5725	-41.41	4.08	0.24	-37.09	Average	27	Pass
NVNT	be40	5795	Ant4	5850	-44.12	4.08	-	-40.04	Peak	27	Pass
NVNT	be40	5795	Ant4	5850	-54.4	4.08	0.24	-50.08	Average	27	Pass
NVNT	be40	5795	Ant4	5855	-46.53	4.08	-	-42.45	Peak	15.6	Pass
NVNT	be40	5795	Ant4	5855	-54.97	4.08	0.24	-50.65	Average	15.6	Pass
NVNT	be40	5795	Ant4	5875	-48.51	4.08	-	-44.43	Peak	10	Pass
NVNT	be40	5795	Ant4	5875	-57.41	4.08	0.24	-53.09	Average	10	Pass
NVNT	be40	5795	Ant4	5925	-49.41	4.08	-	-45.33	Peak	-27	Pass
NVNT	be40	5795	Ant4	5925	-56.62	4.08	0.24	-52.30	Average	-27	Pass
NVNT	be80	5775	Ant4	5850	-33.78	4.08	-	-29.70	Peak	27	Pass
NVNT	be80	5775	Ant4	5850	-43.48	4.08	0.47	-38.93	Average	27	Pass
NVNT	be80	5775	Ant4	5855	-36.25	4.08	-	-32.17	Peak	15.6	Pass
NVNT	be80	5775	Ant4	5855	-44.58	4.08	0.47	-40.03	Average	15.6	Pass
NVNT	be80	5775	Ant4	5875	-36.71	4.08	-	-32.63	Peak	10	Pass
NVNT	be80	5775	Ant4	5875	-51.35	4.08	0.47	-46.80	Average	10	Pass
NVNT	be80	5775	Ant4	5925	-49.08	4.08	-	-45.00	Peak	-27	Pass
NVNT	be80	5775	Ant4	5925	-56.63	4.08	0.47	-52.08	Average	-27	Pass
NVNT	be80	5775	Ant4	5650	-47.97	4.08	-	-43.89	Peak	-27	Pass
NVNT	be80	5775	Ant4	5650	-55.69	4.08	0.47	-51.14	Average	-27	Pass
NVNT	be80	5775	Ant4	5700	-35.26	4.08	-	-31.18	Peak	10	Pass
NVNT	be80	5775	Ant4	5700	-44.47	4.08	0.47	-39.92	Average	10	Pass
NVNT	be80	5775	Ant4	5720	-30.35	4.08	-	-26.27	Peak	15.6	Pass
NVNT	be80	5775	Ant4	5720	-40.42	4.08	0.47	-35.87	Average	15.6	Pass
NVNT	be80	5775	Ant4	5725	-22.92	4.08	-	-18.84	Peak	27	Pass
NVNT	be80	5775	Ant4	5725	-39.51	4.08	0.47	-34.96	Average	27	Pass






Test Graphs

Restrict Band NVNT a 5745MHz Ant4 Peak

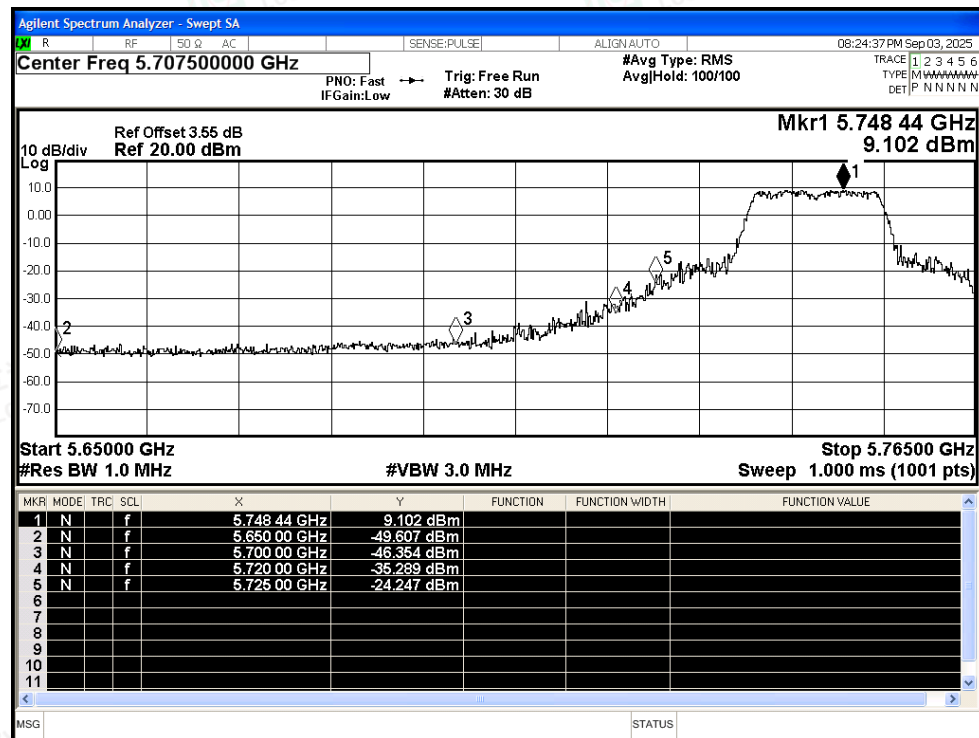

Restrict Band NVNT a 5745MHz Ant4 Average

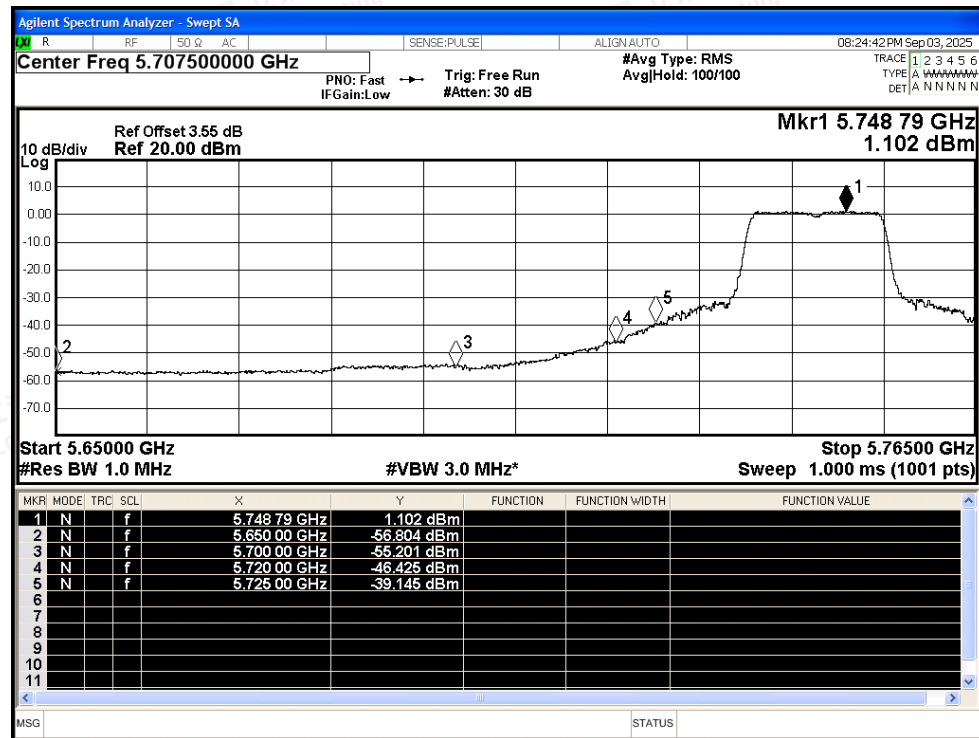

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant4 Peak

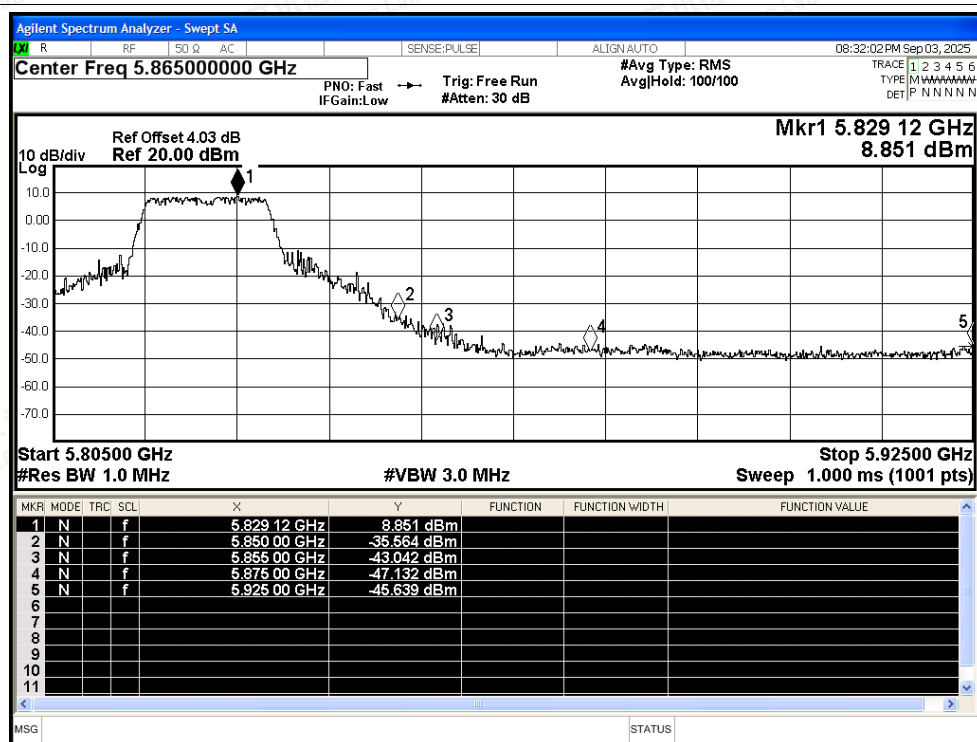

Restrict Band NVNT a 5825MHz Ant4 Average

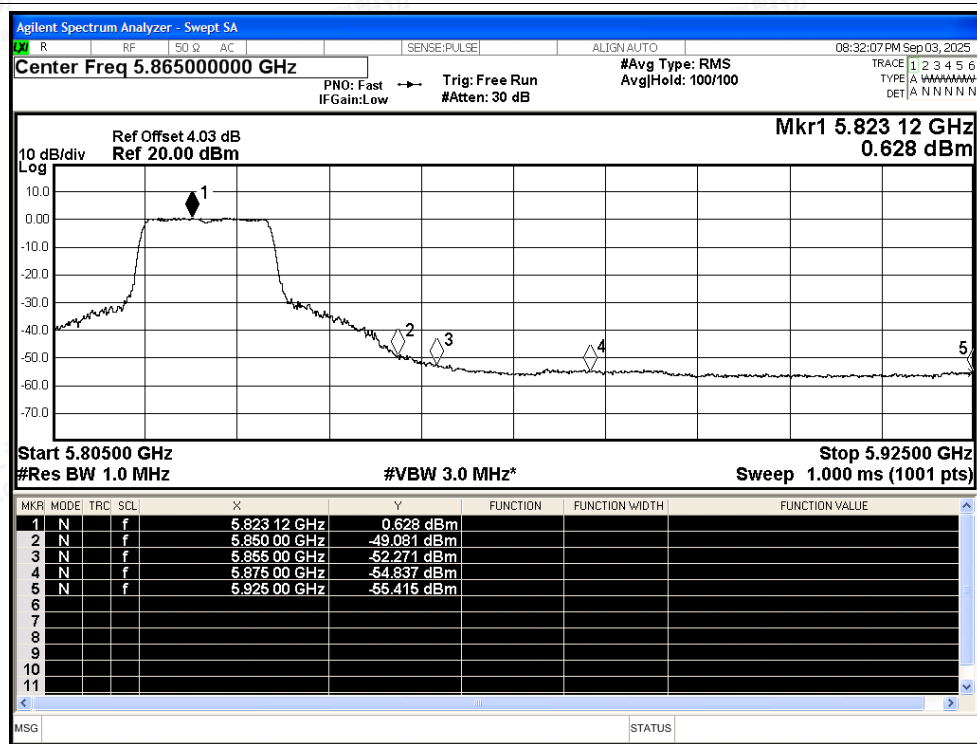

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5745MHz Ant4 Peak

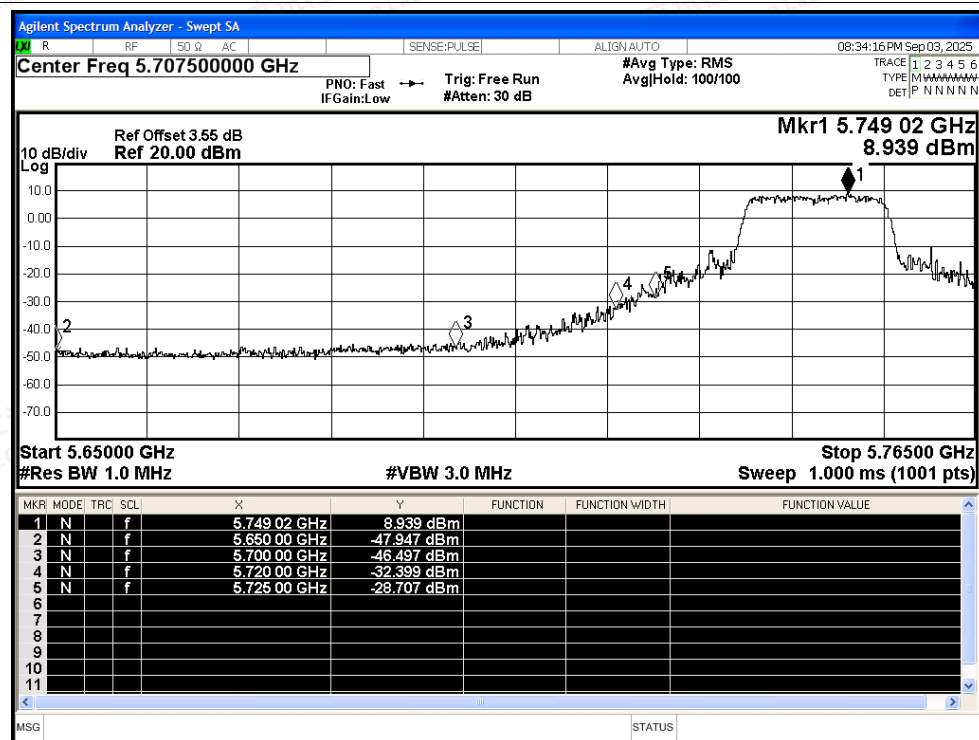

Restrict Band NVNT n20 5745MHz Ant4 Average

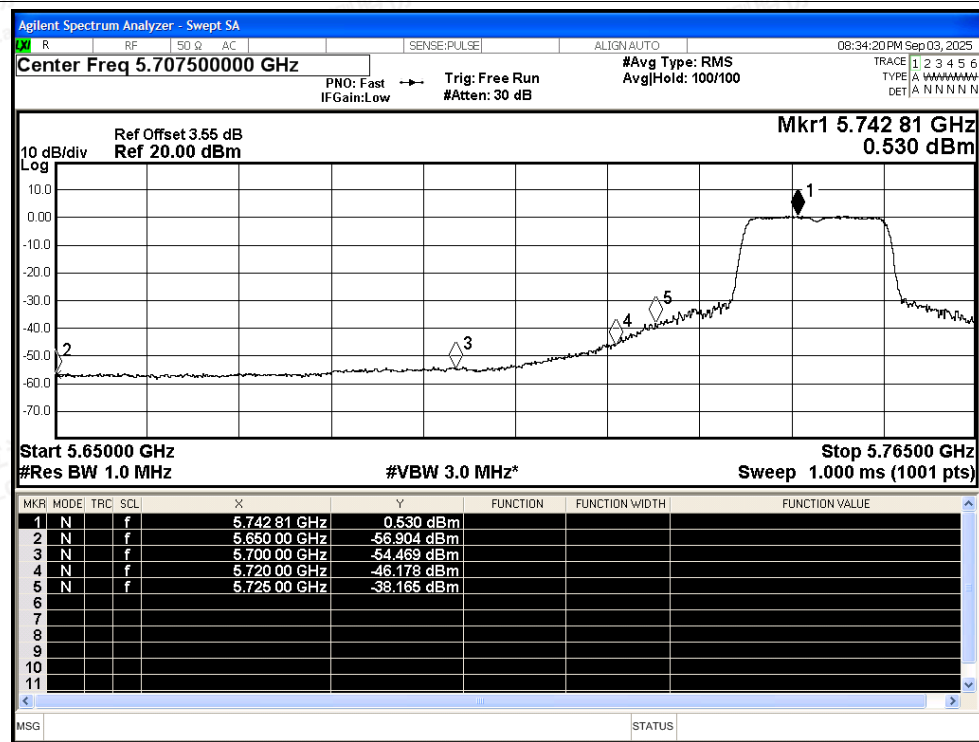

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant4 Peak

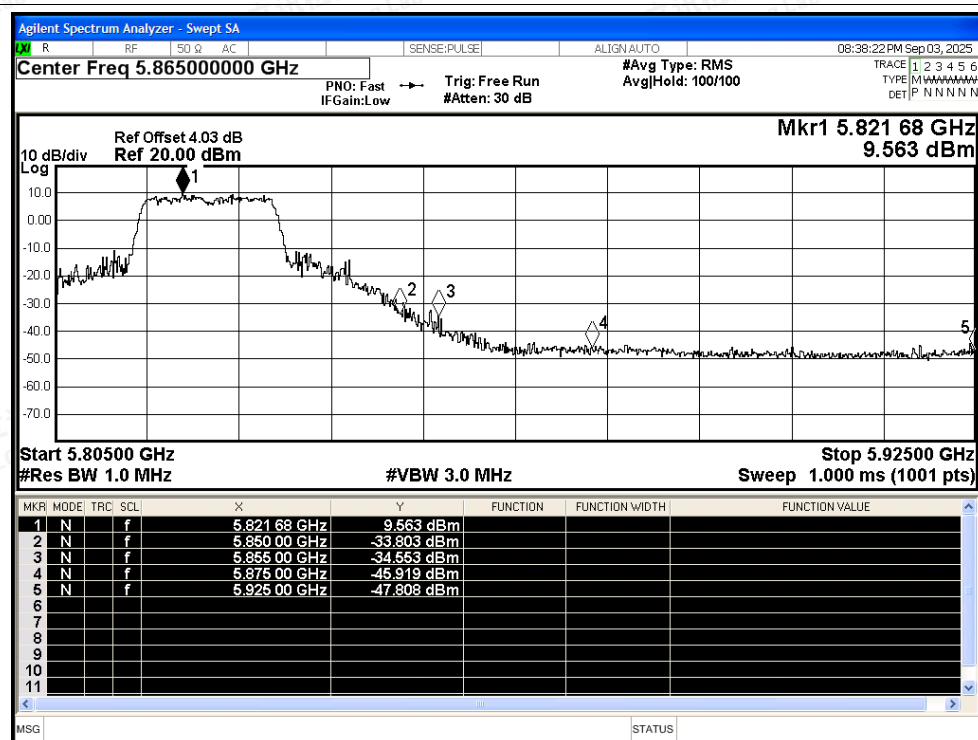

Restrict Band NVNT n20 5825MHz Ant4 Average

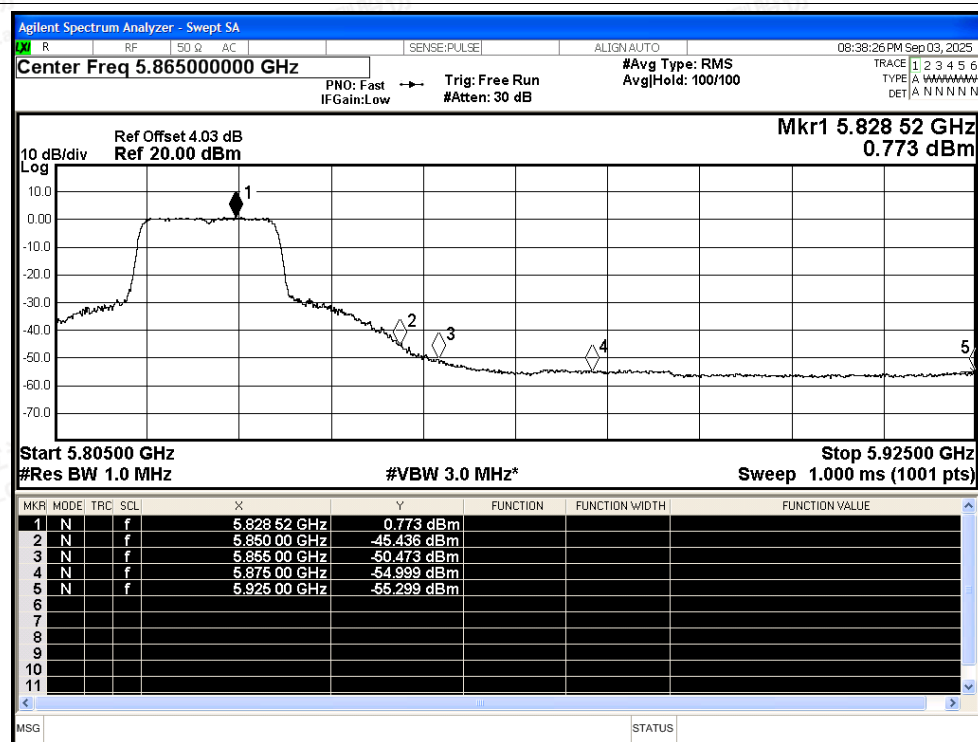

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant4 Peak

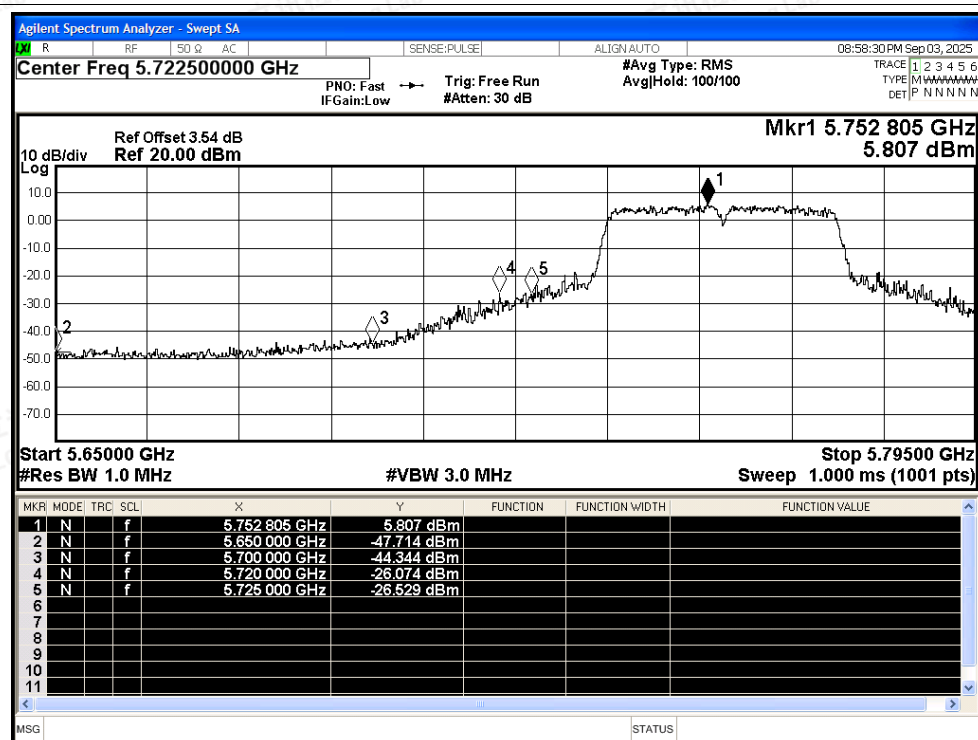

Restrict Band NVNT n40 5755MHz Ant4 Average

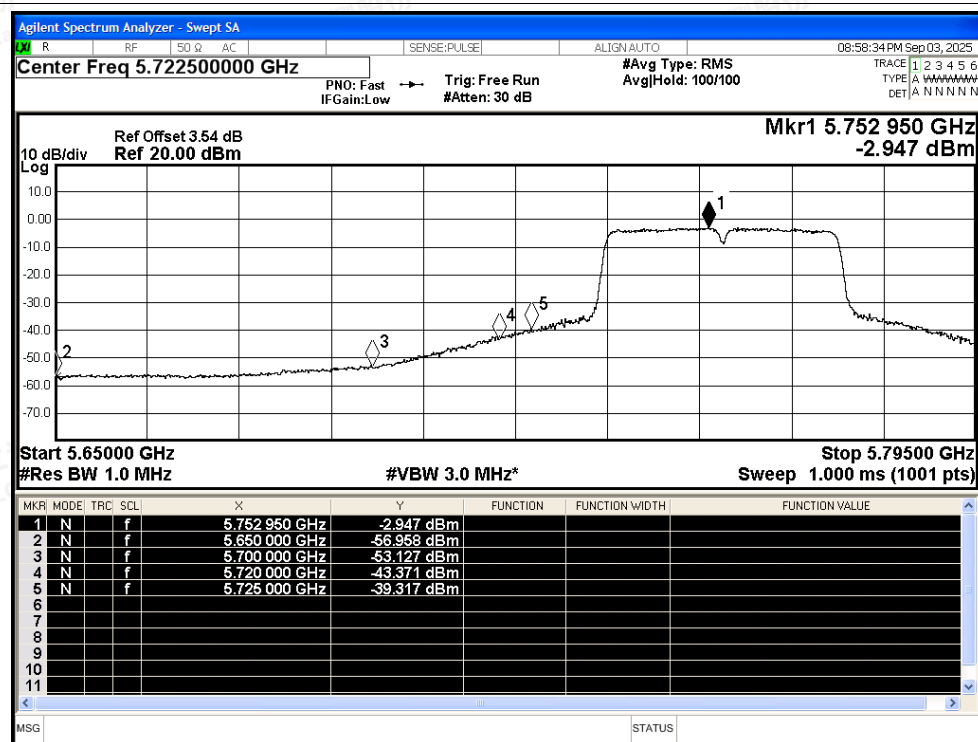

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant4 Peak

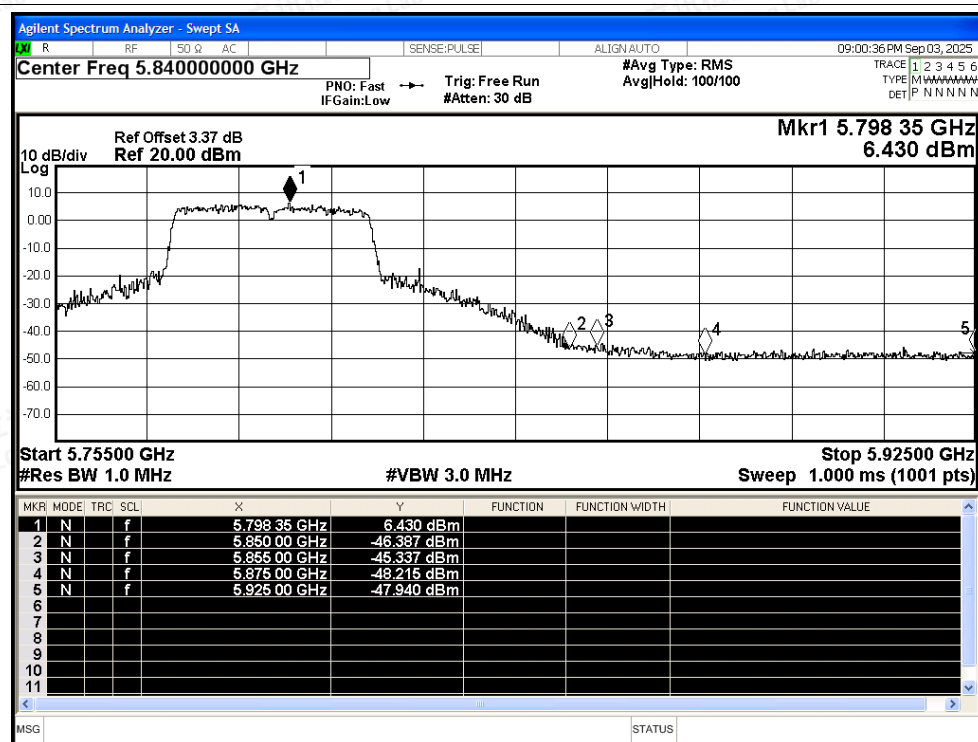

Restrict Band NVNT n40 5795MHz Ant4 Average

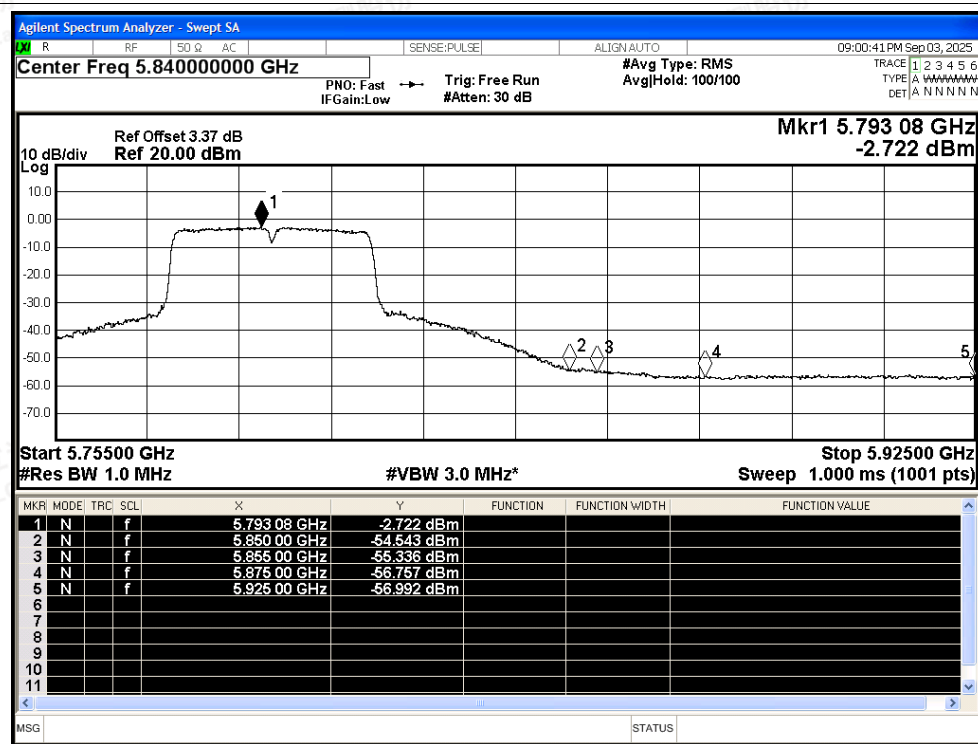

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant4 Peak

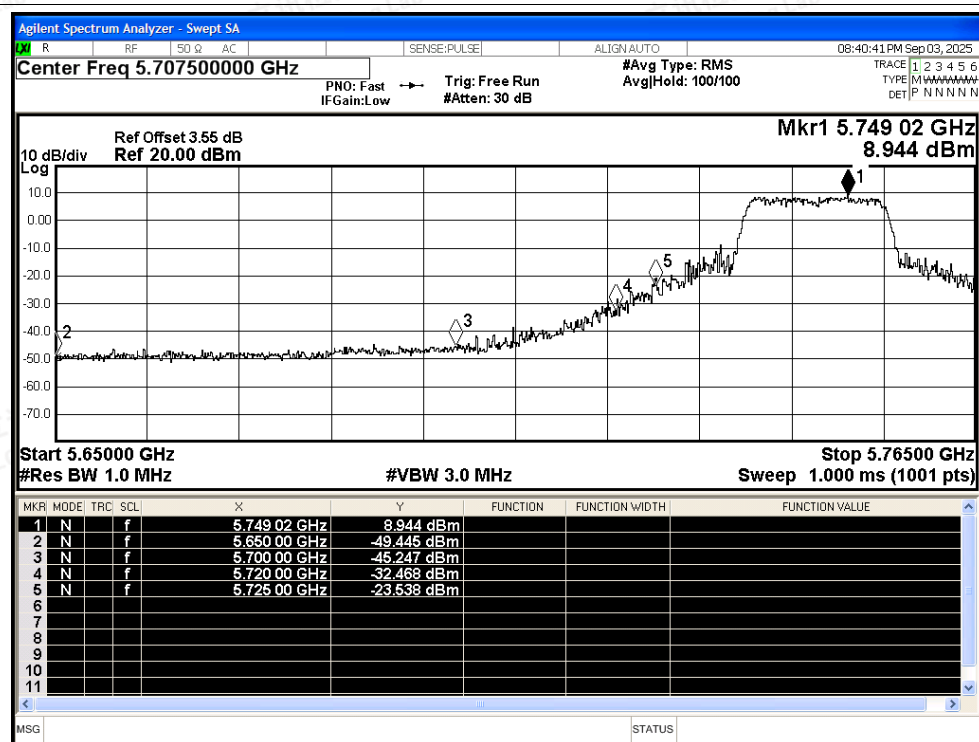

Restrict Band NVNT ac20 5745MHz Ant4 Average

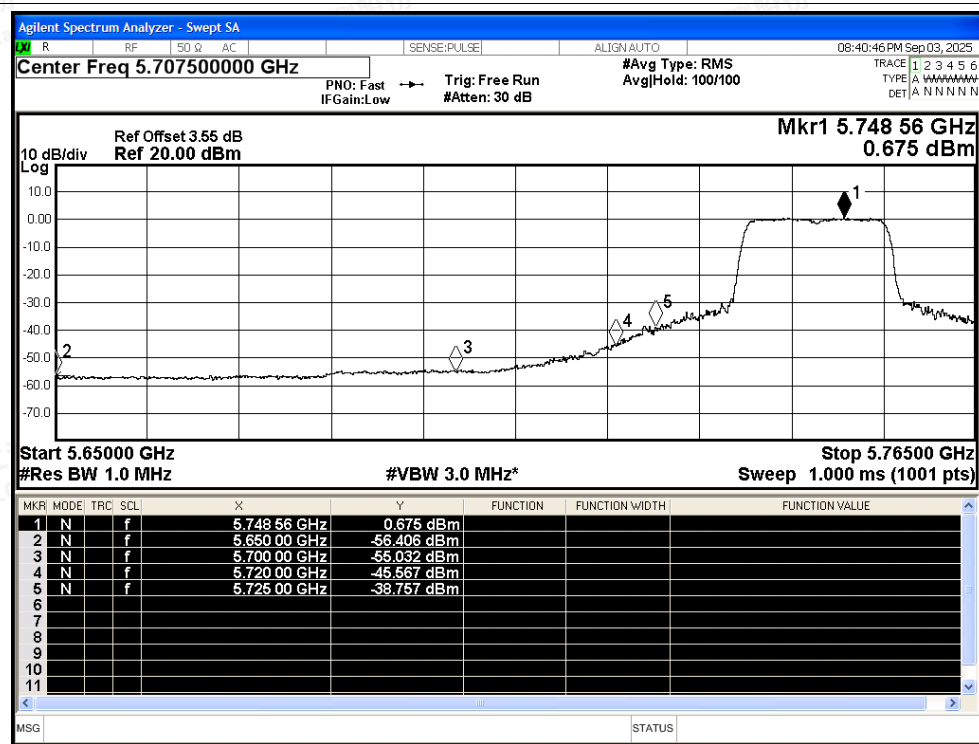

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant4 Peak

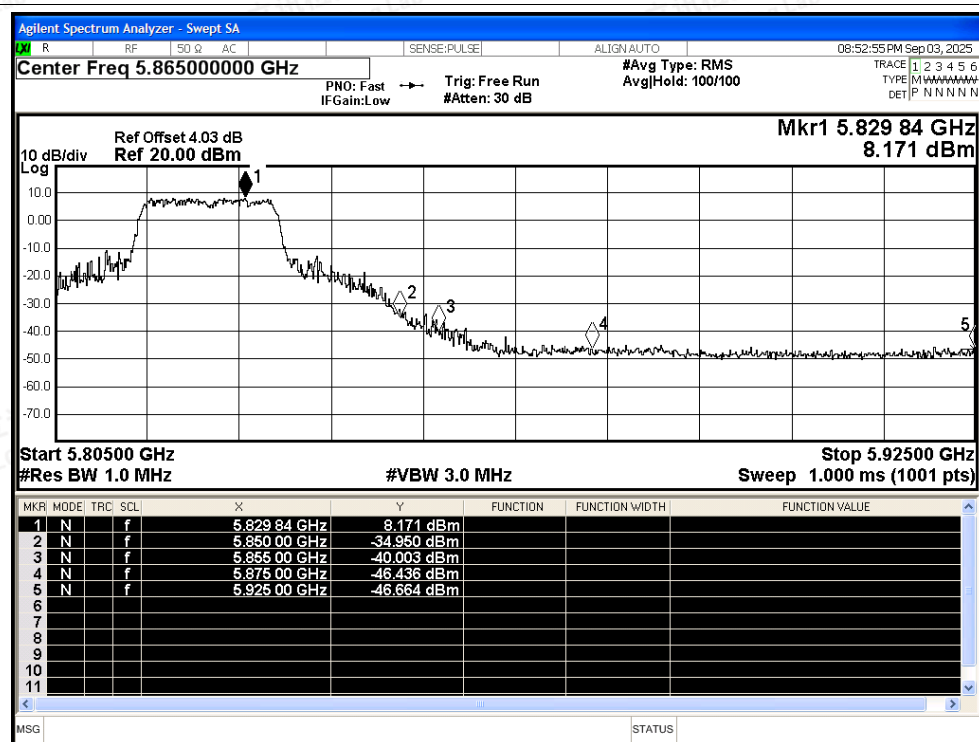

Restrict Band NVNT ac20 5825MHz Ant4 Average

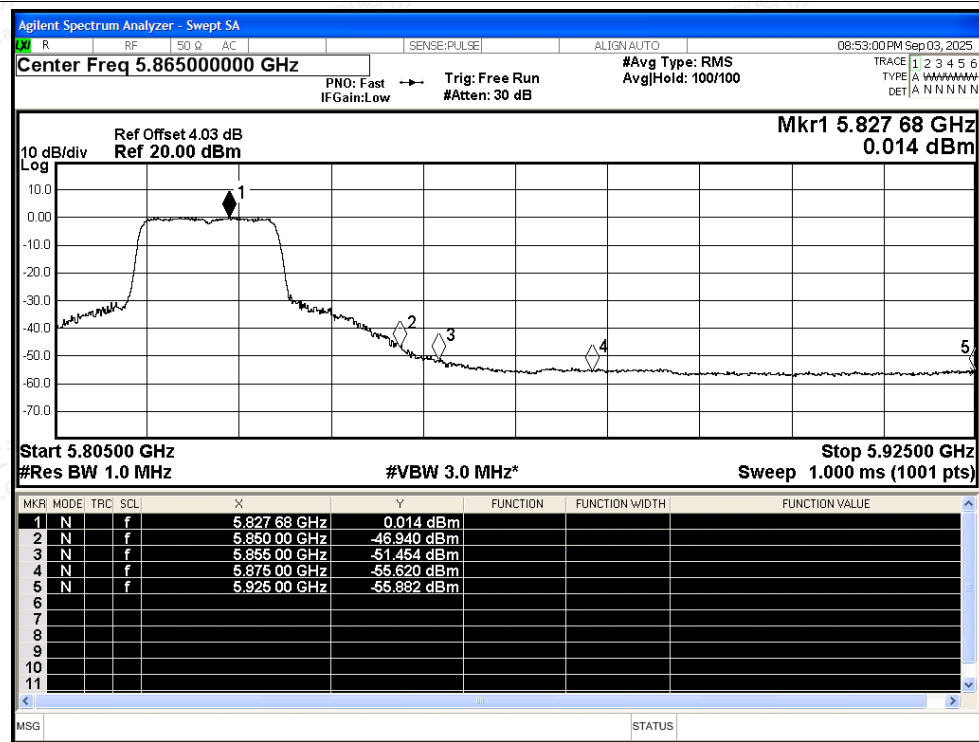

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant4 Peak

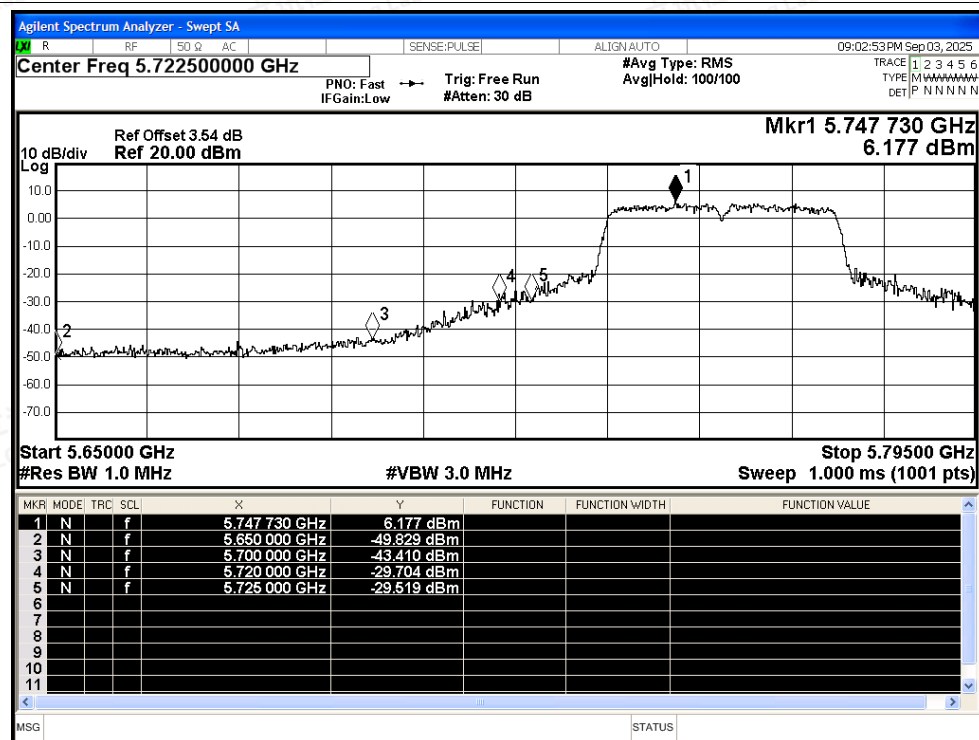

Restrict Band NVNT ac40 5755MHz Ant4 Average

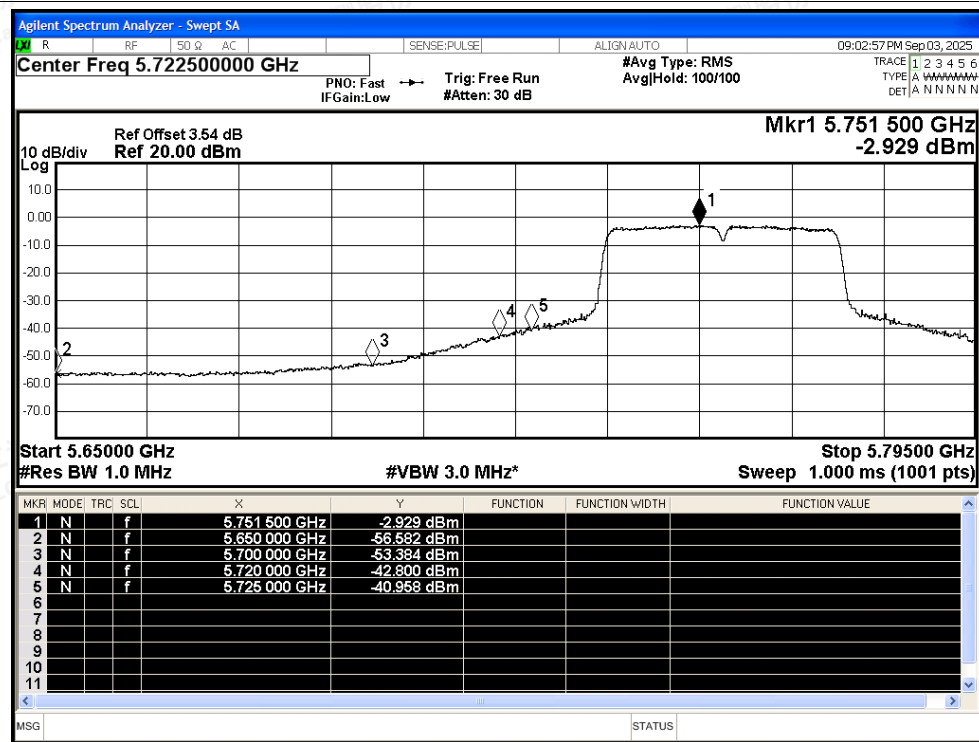

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant4 Peak

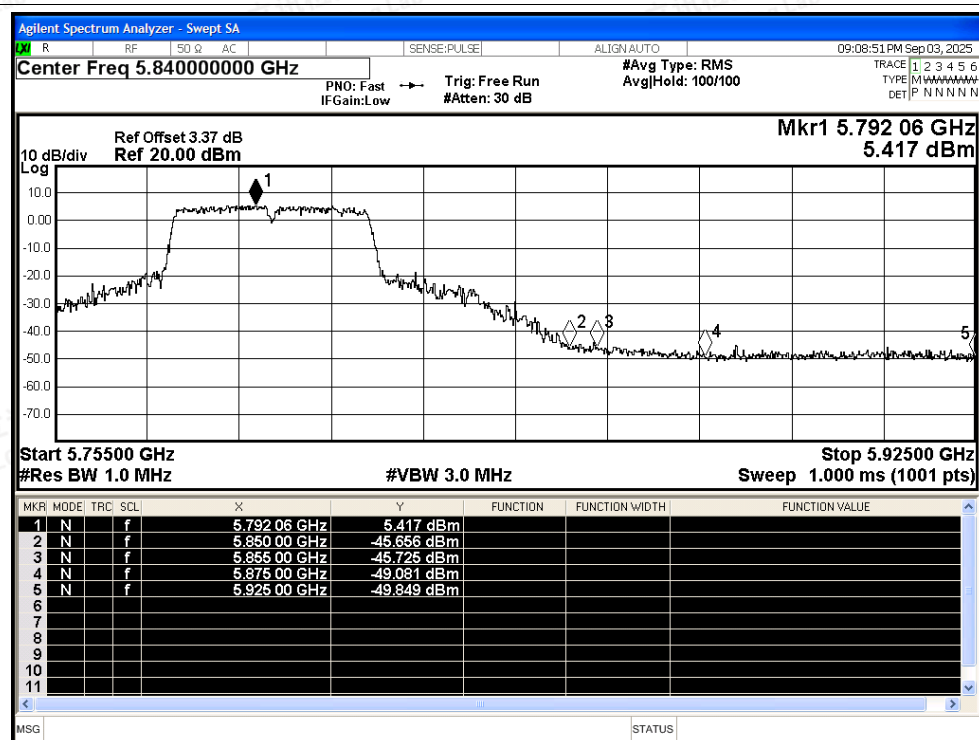

Restrict Band NVNT ac40 5795MHz Ant4 Average

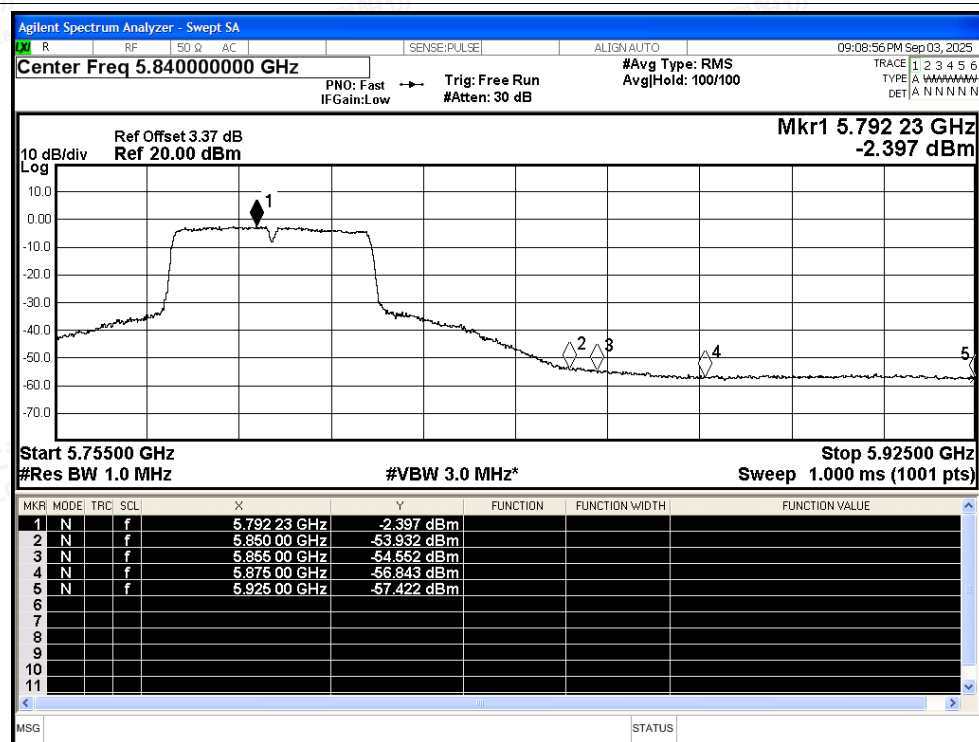

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant4 Peak

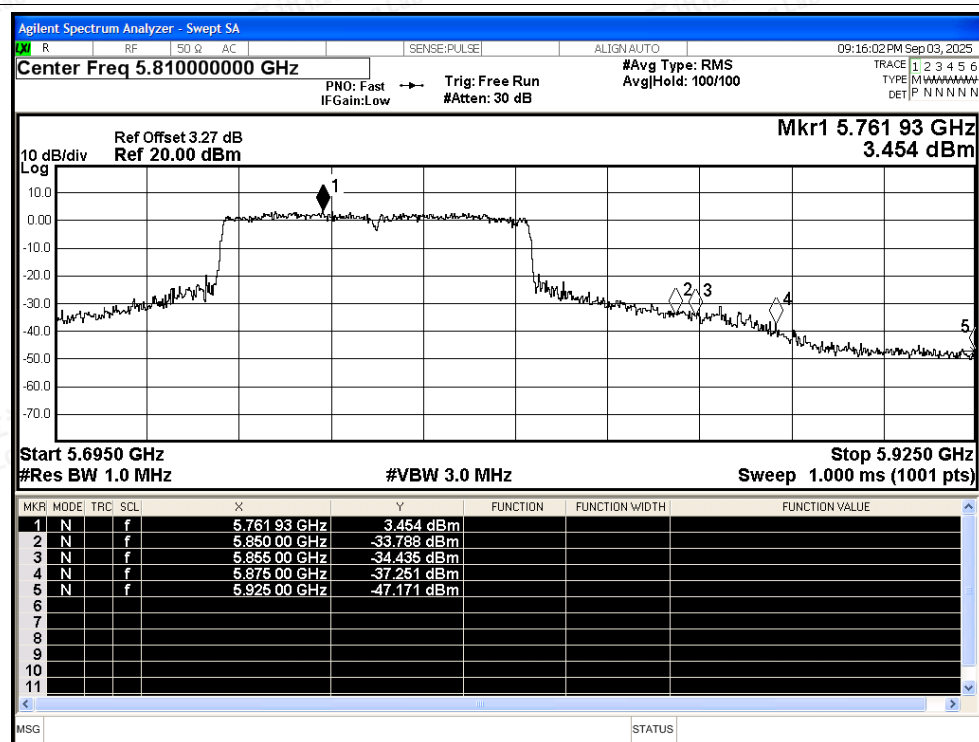

Restrict Band NVNT ac80 5775MHz Ant4 Average

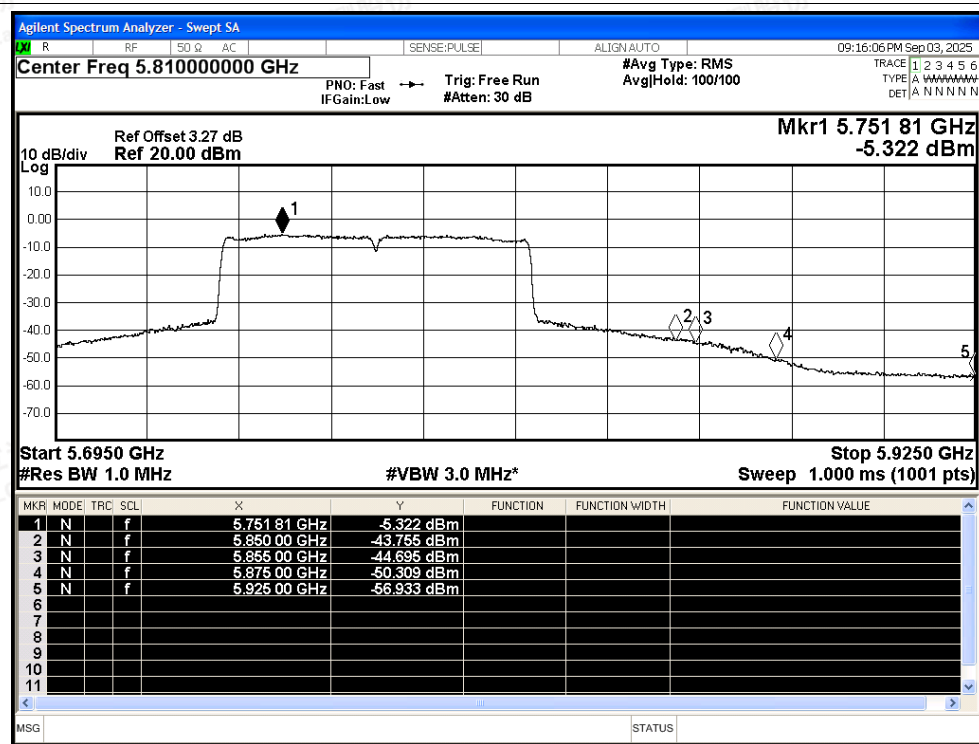

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant4 Peak

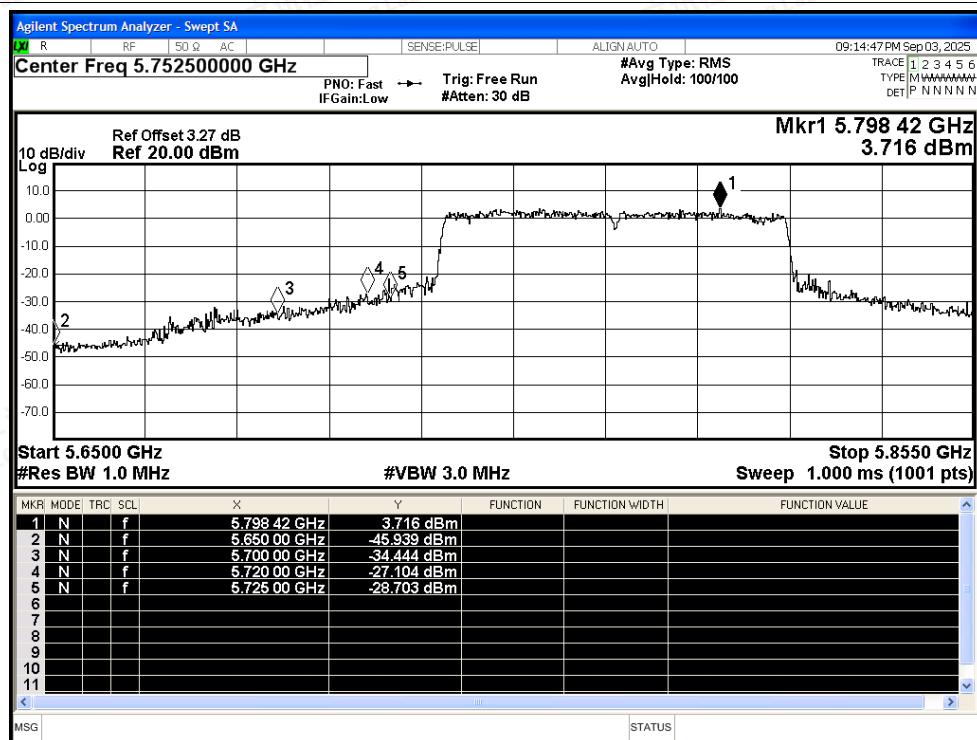

Restrict Band NVNT ac80 5775MHz Ant4 Average

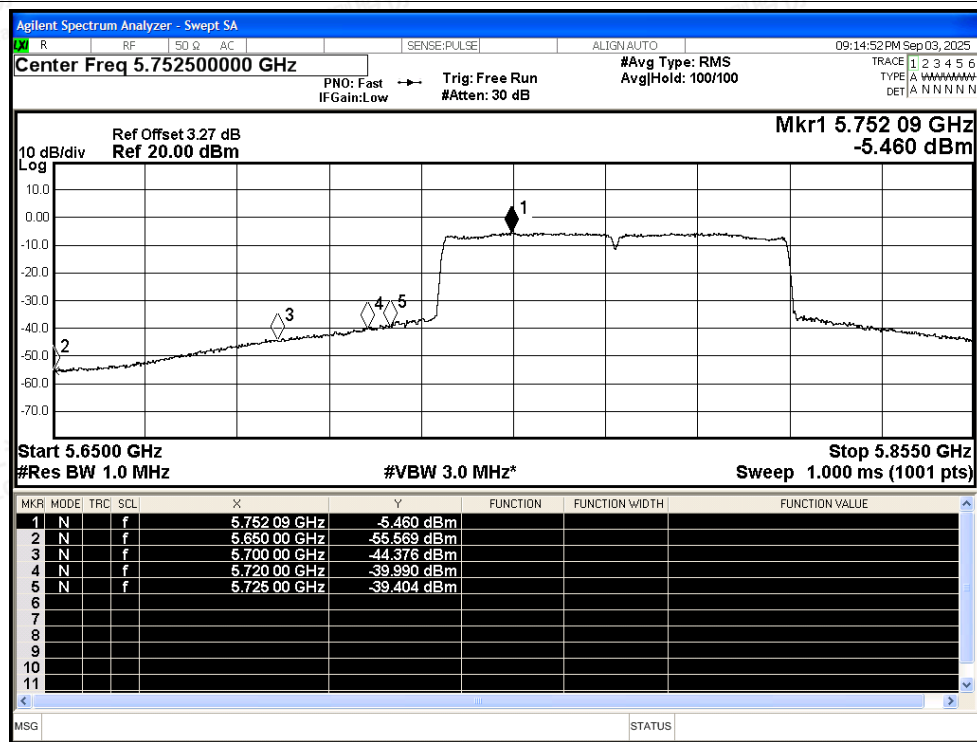

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant4 Peak

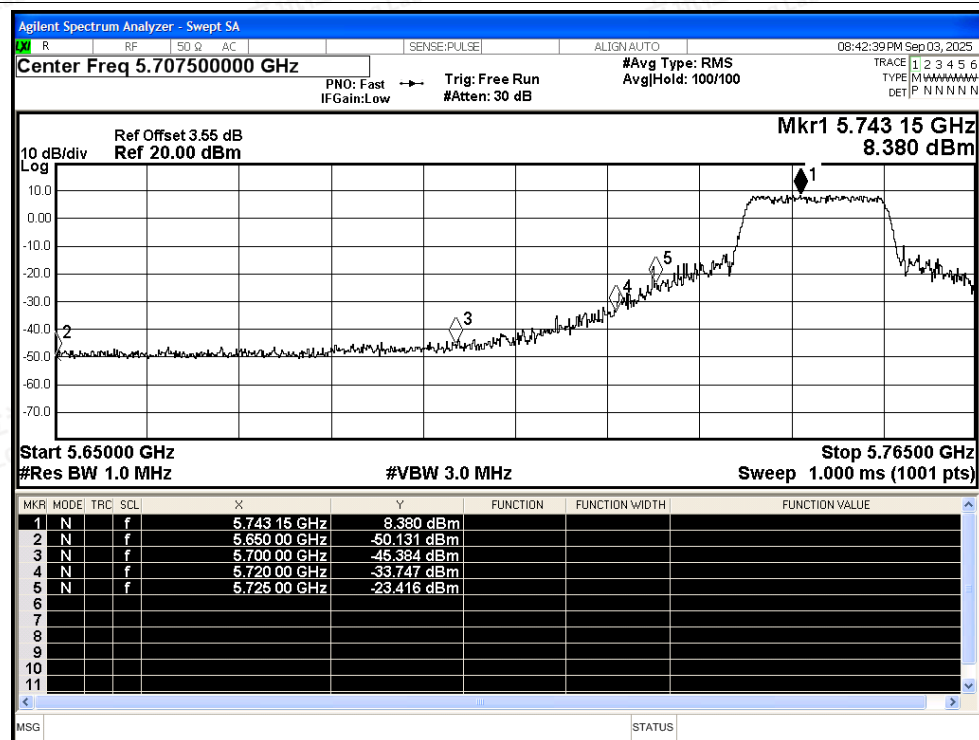

Restrict Band NVNT ax20 5745MHz Ant4 Average

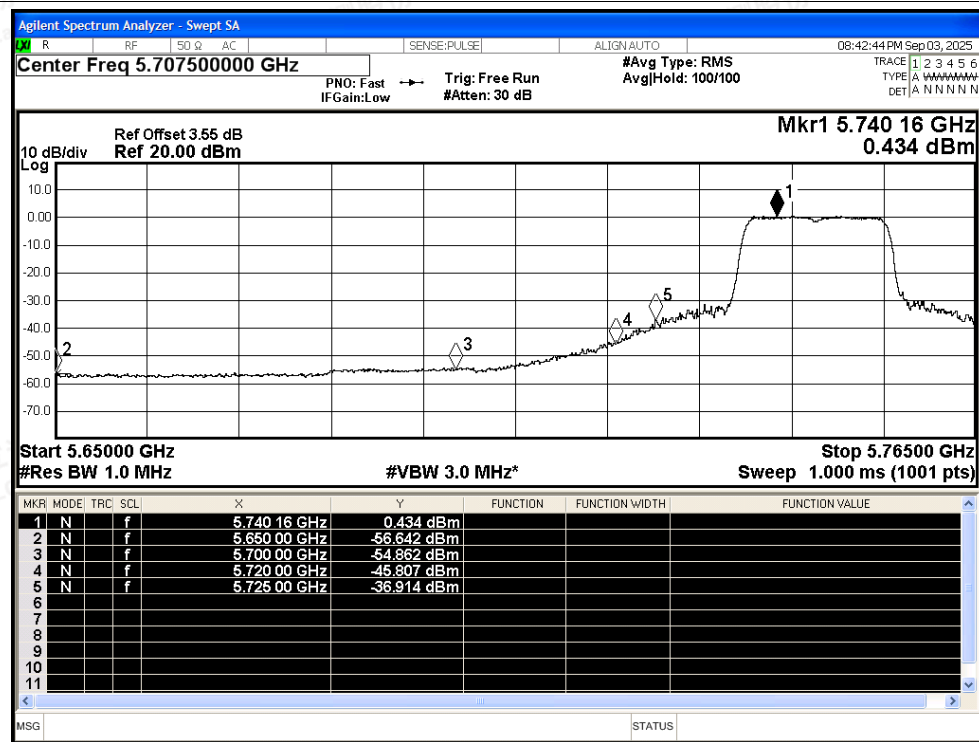

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant4 Peak

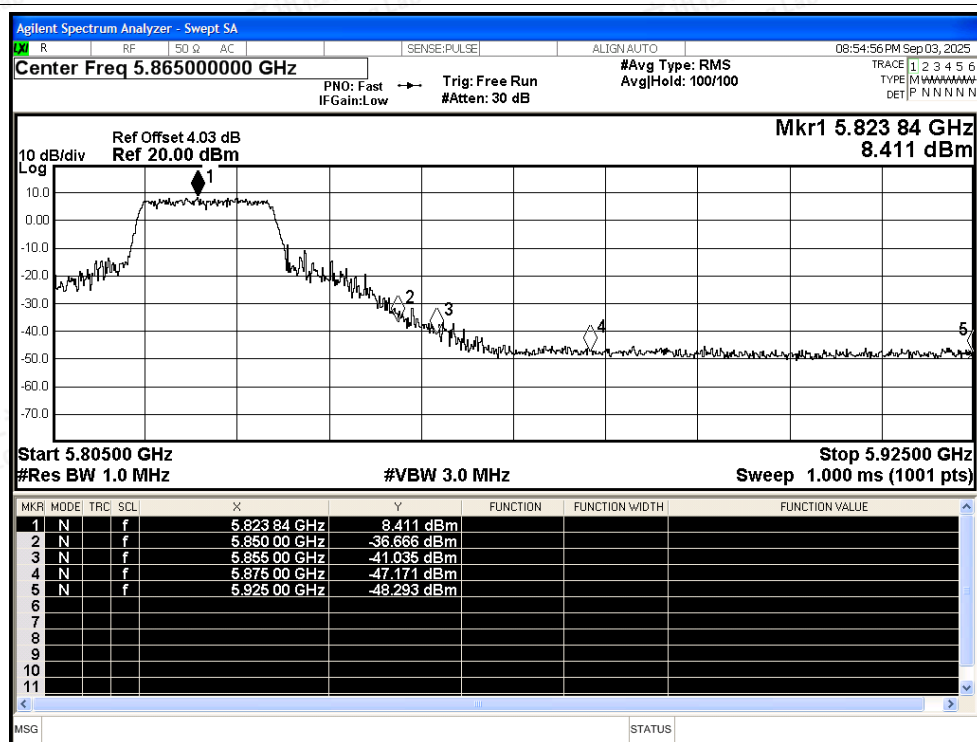

Restrict Band NVNT ax20 5825MHz Ant4 Average

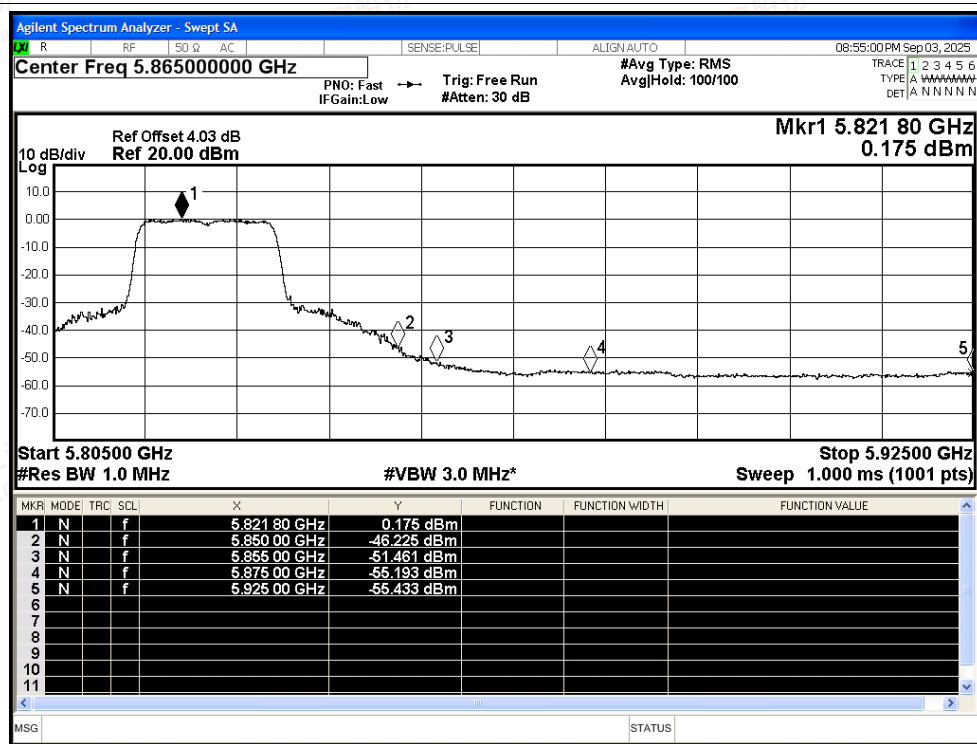

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant4 Peak

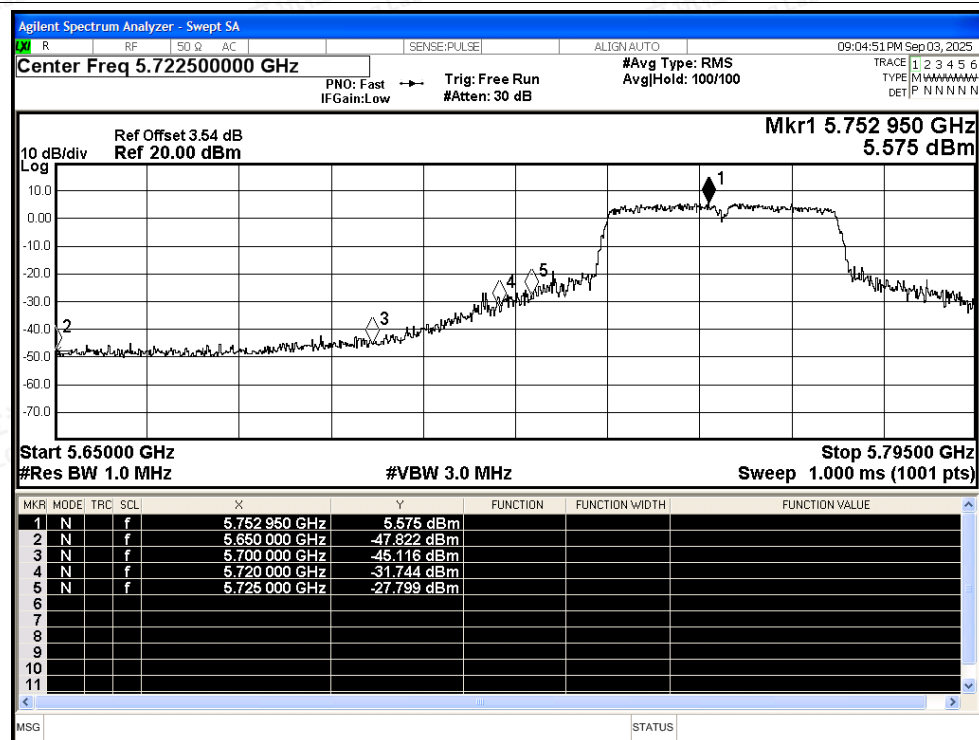

Restrict Band NVNT ax40 5755MHz Ant4 Average

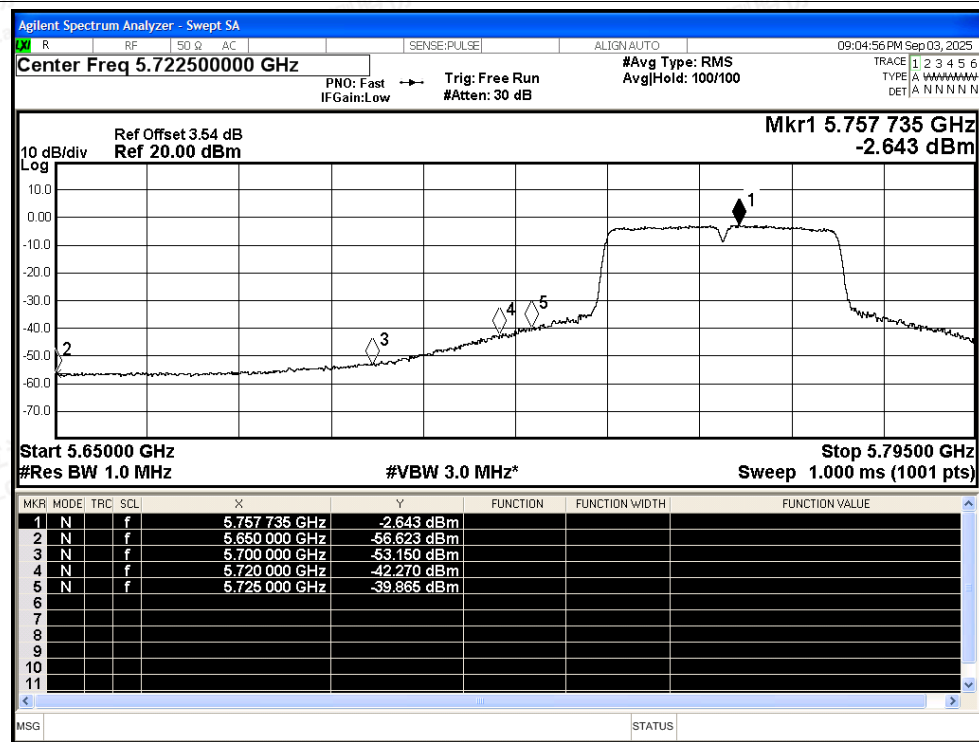

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant4 Peak

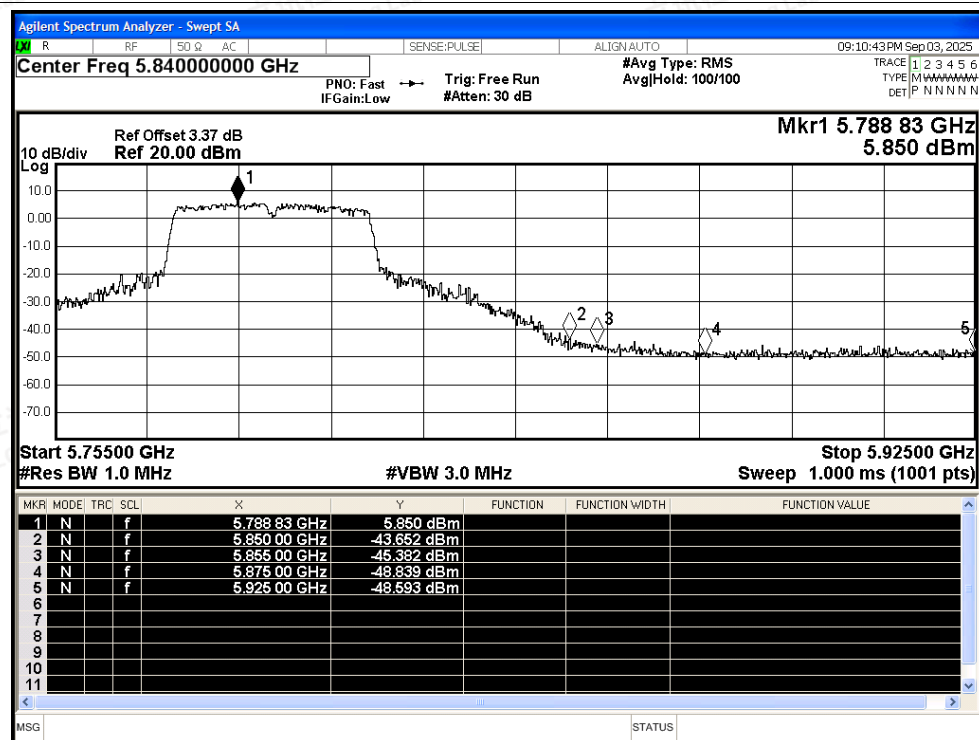

Restrict Band NVNT ax40 5795MHz Ant4 Average

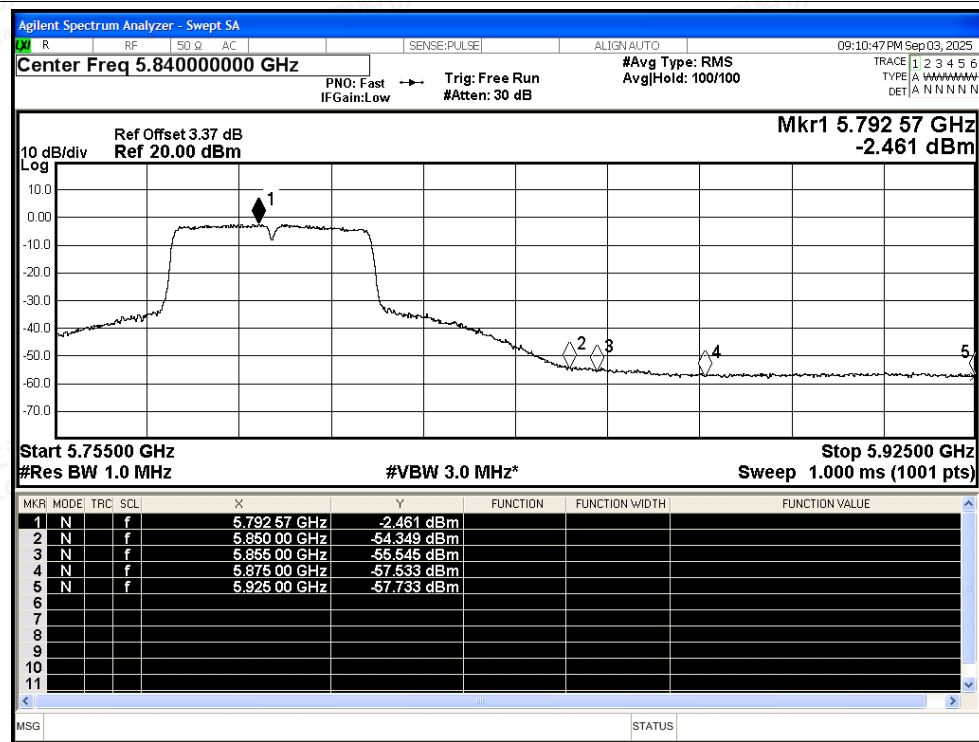

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant4 Peak

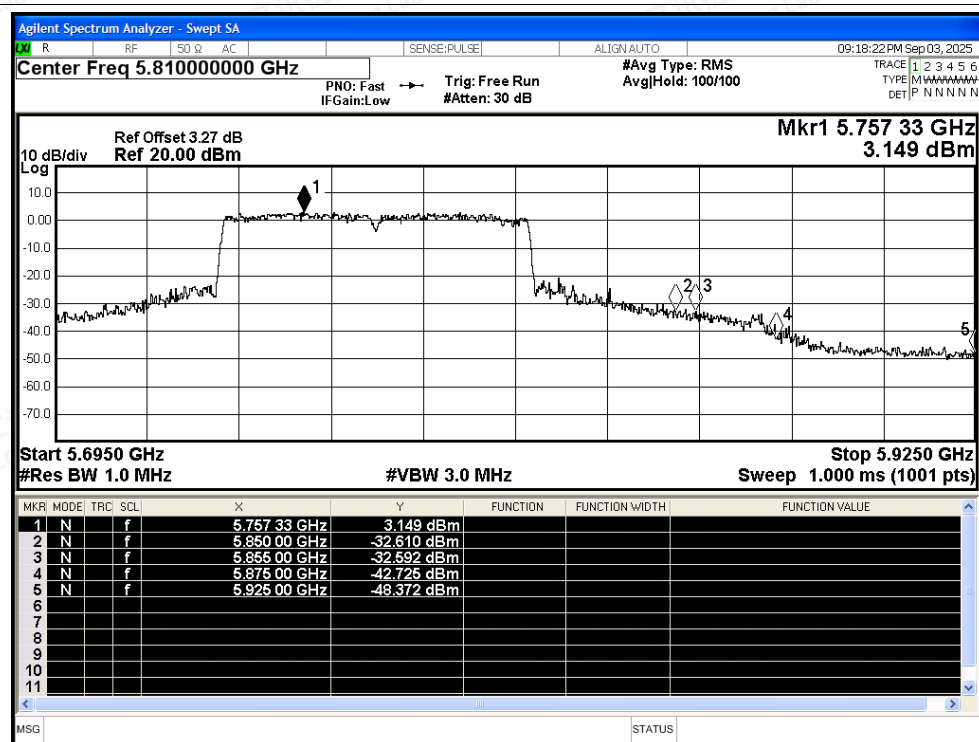

Restrict Band NVNT ax80 5775MHz Ant4 Average

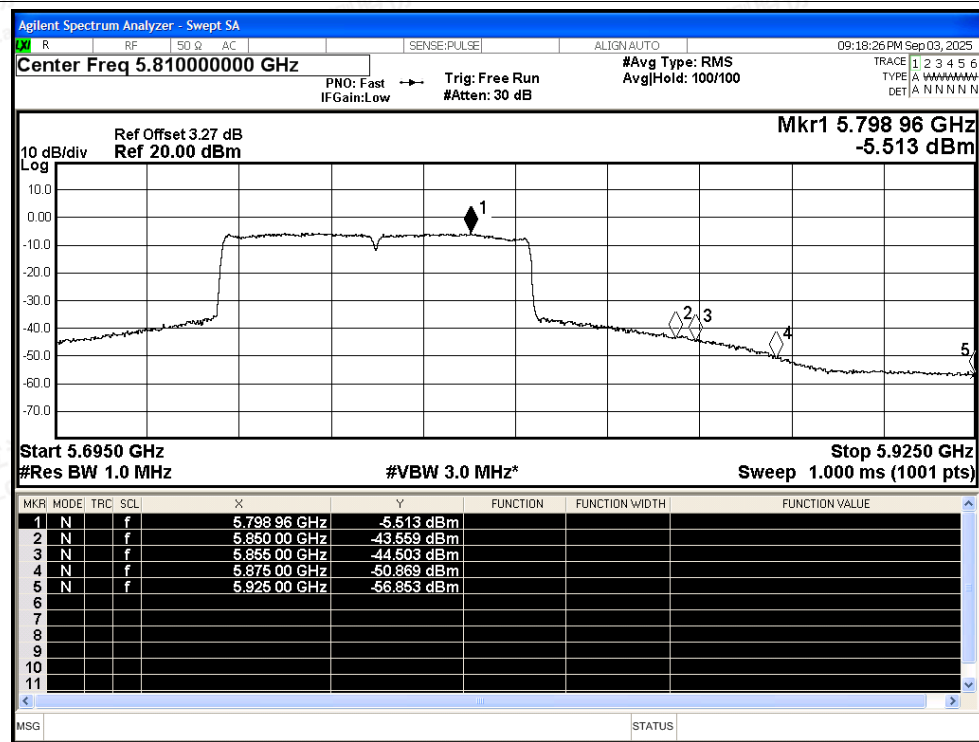

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant4 Peak

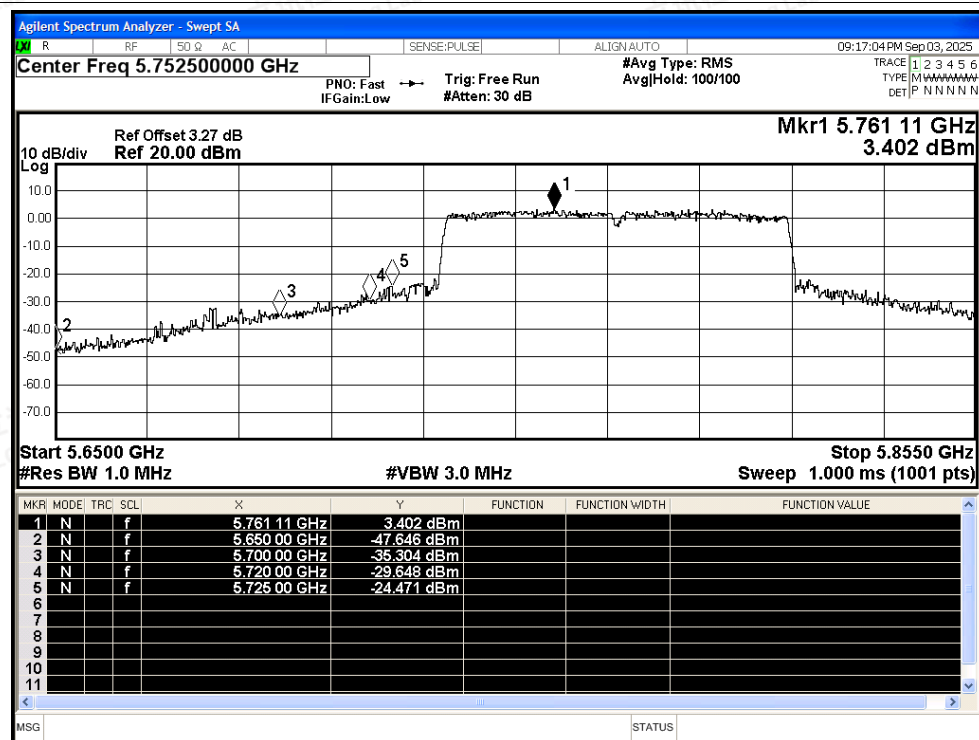

Restrict Band NVNT ax80 5775MHz Ant4 Average

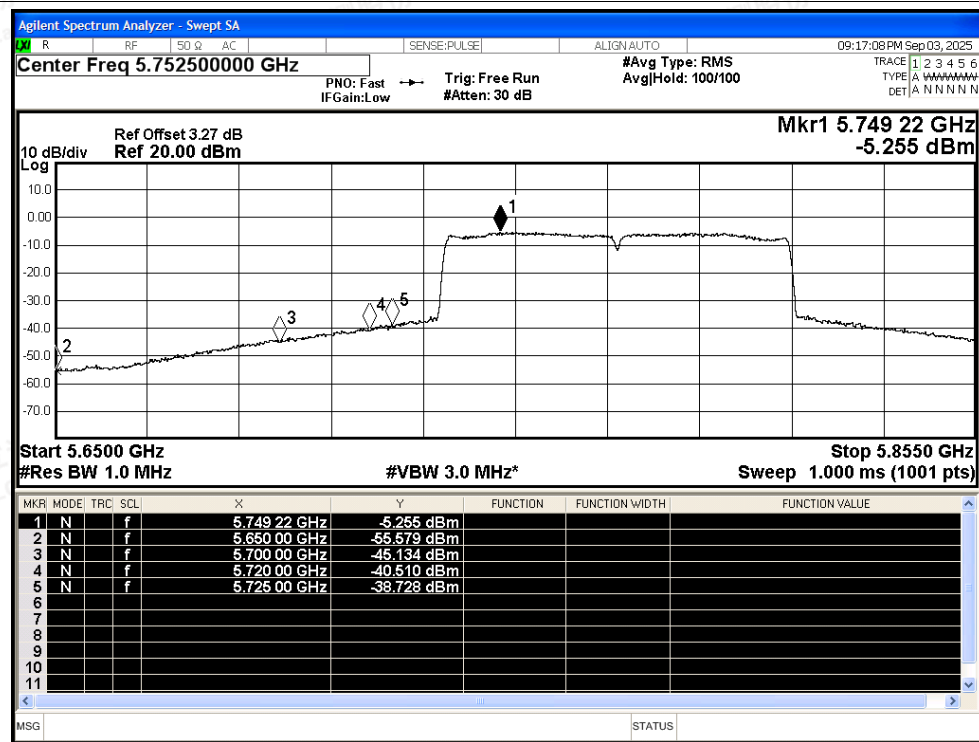

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5745MHz Ant4 Peak

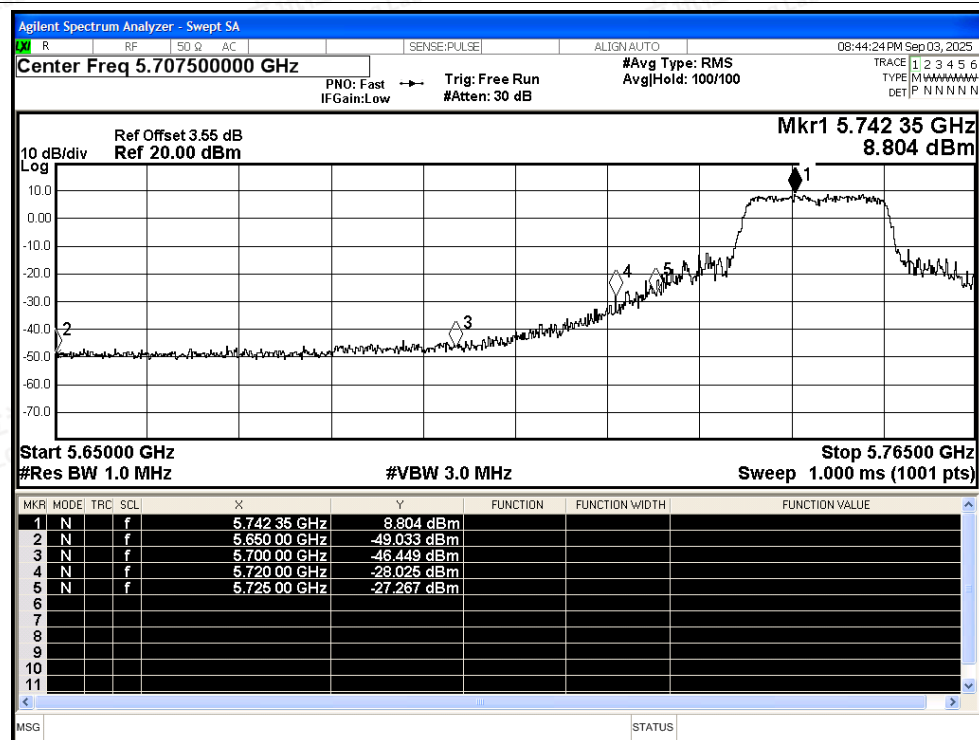

Restrict Band NVNT be20 5745MHz Ant4 Average

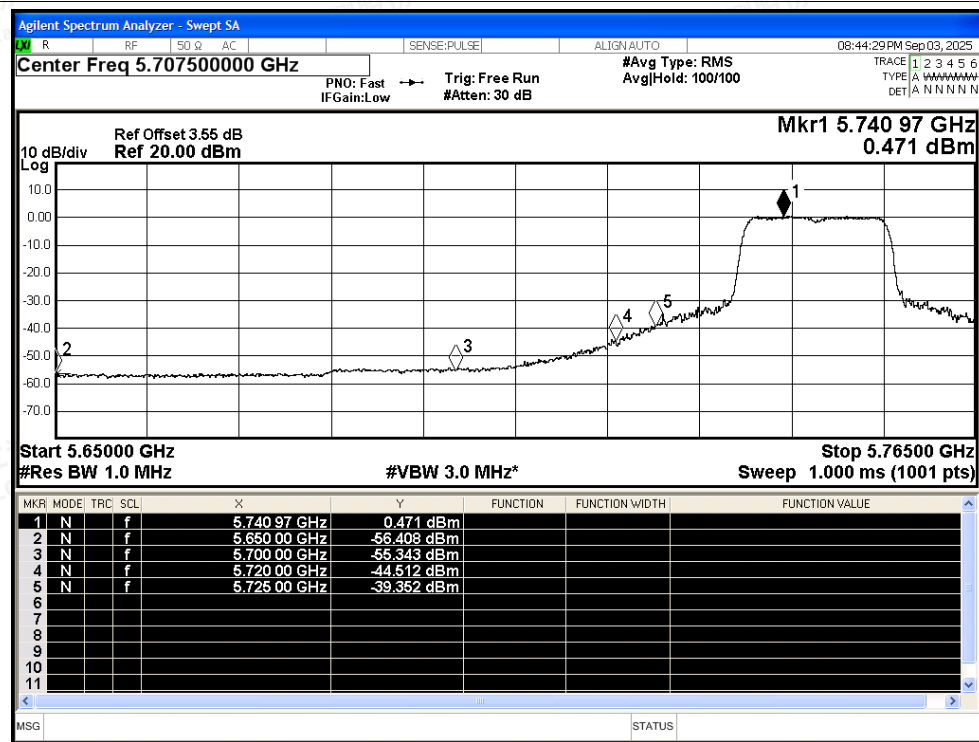

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be20 5825MHz Ant4 Peak

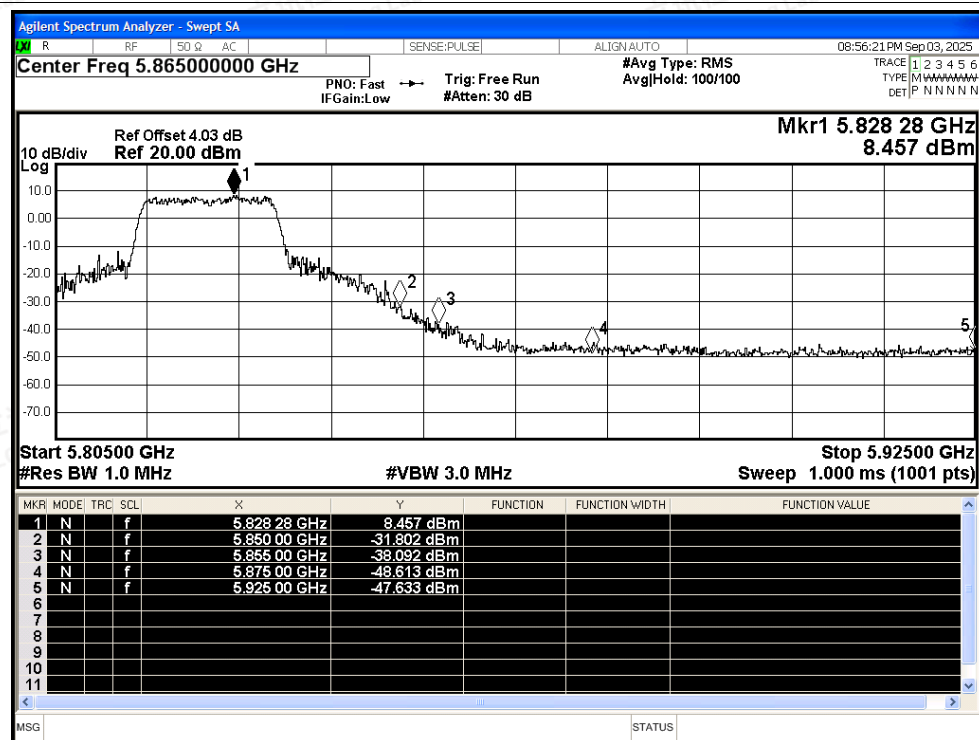

Restrict Band NVNT be20 5825MHz Ant4 Average

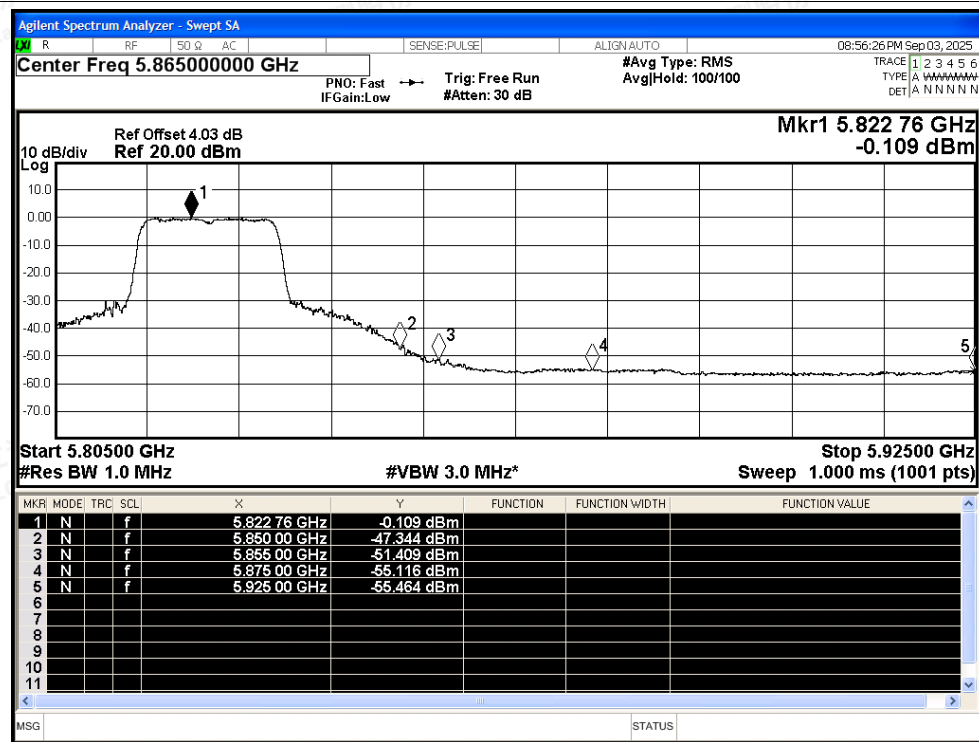

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5755MHz Ant4 Peak

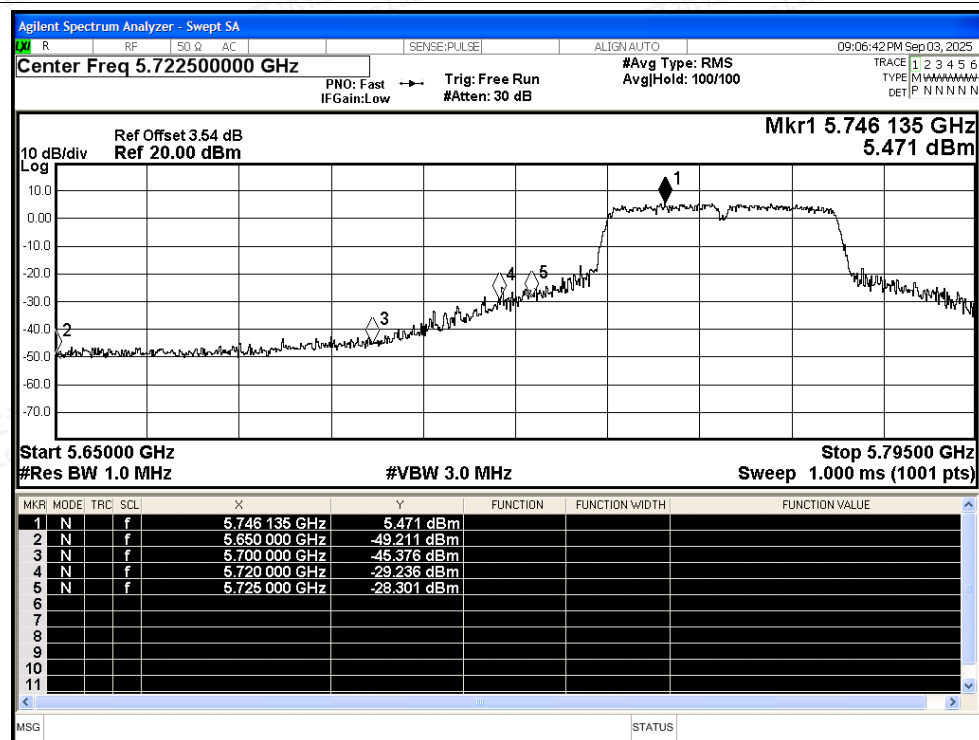

Restrict Band NVNT be40 5755MHz Ant4 Average

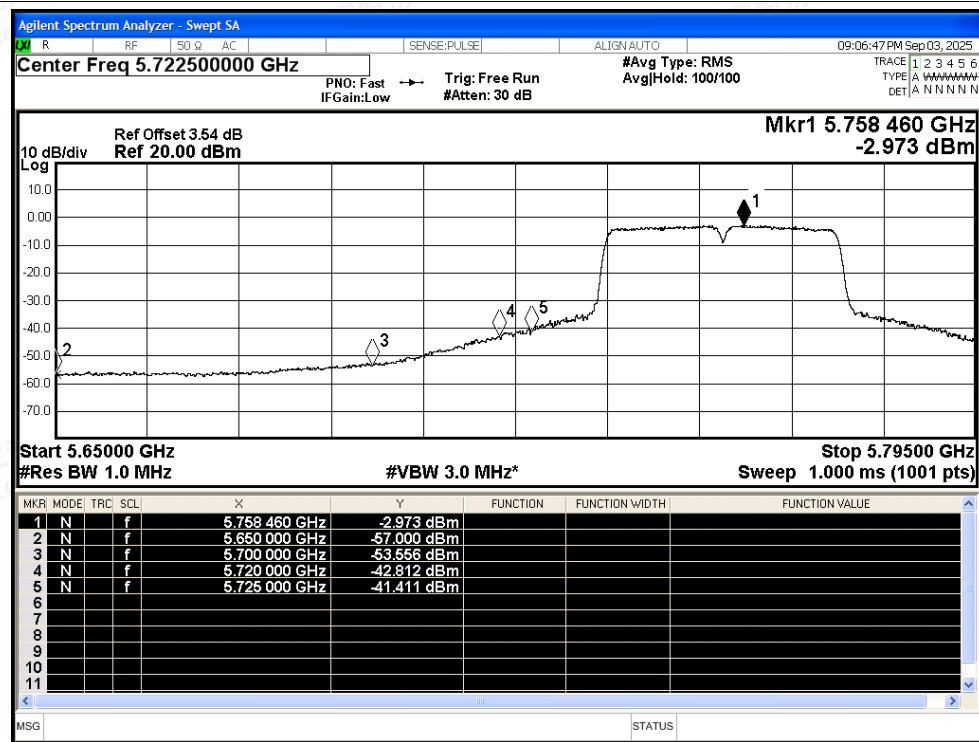

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be40 5795MHz Ant4 Peak

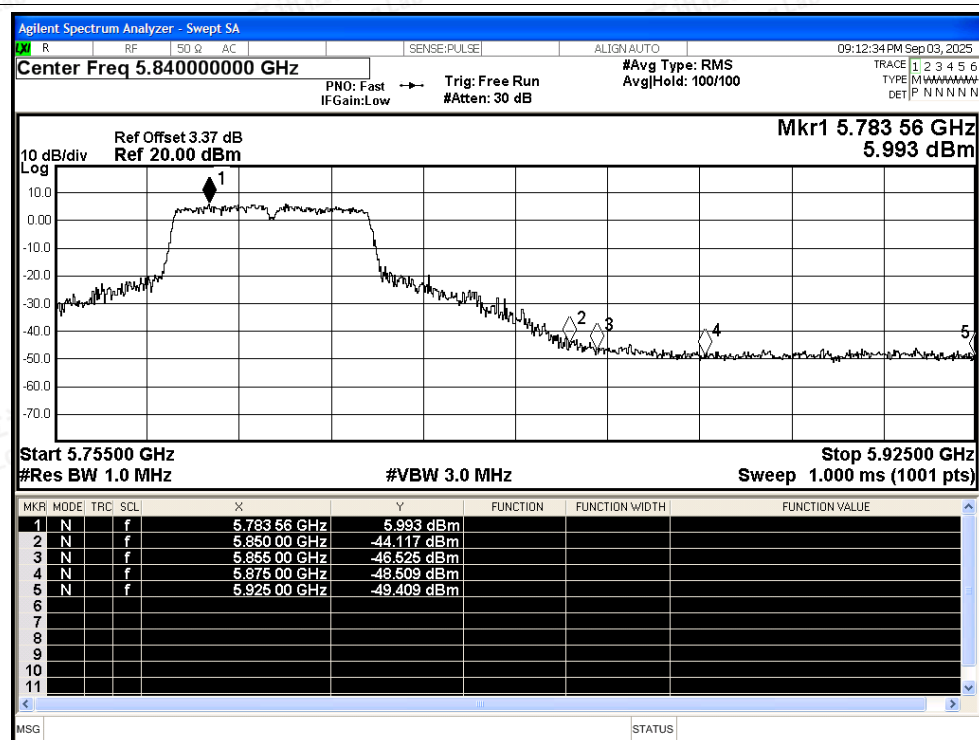

Restrict Band NVNT be40 5795MHz Ant4 Average

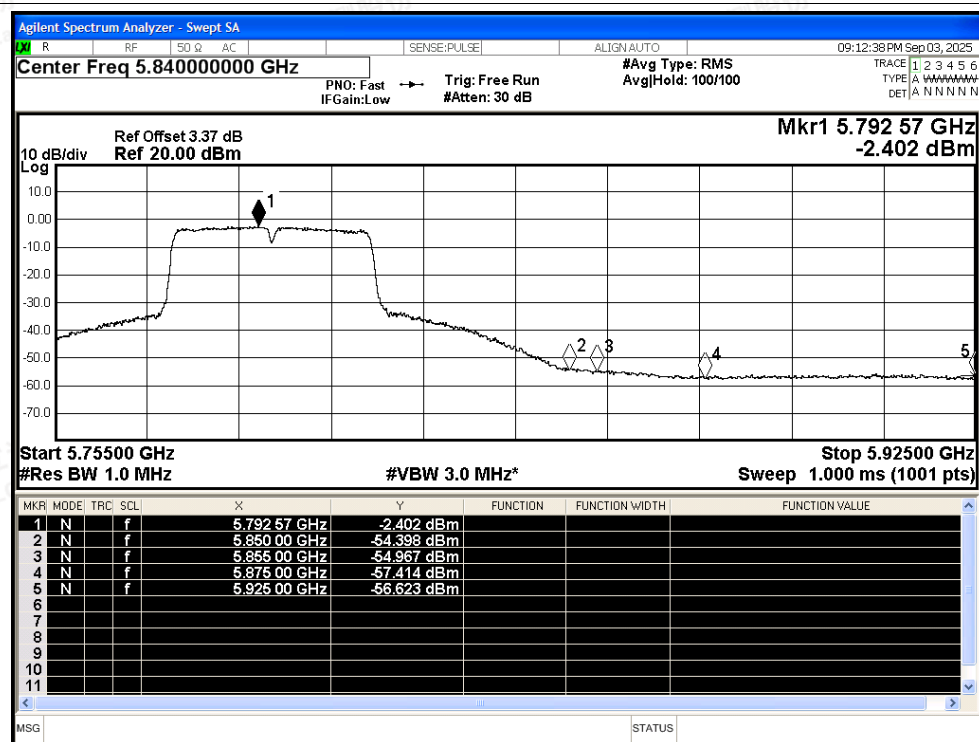

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5775MHz Ant4 Peak

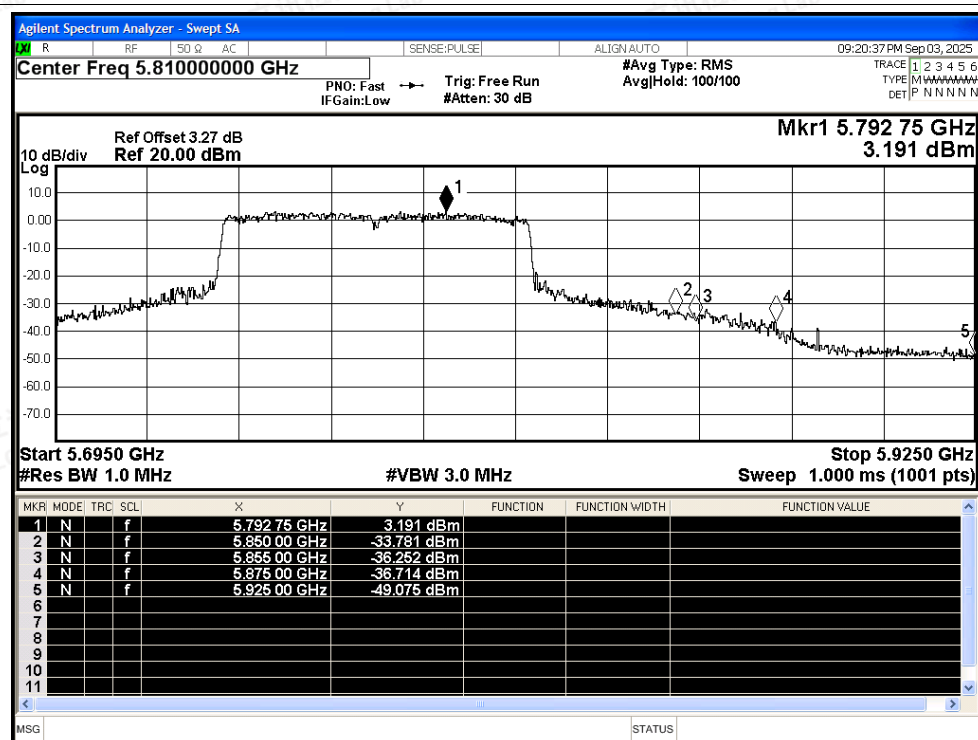

Restrict Band NVNT be80 5775MHz Ant4 Average

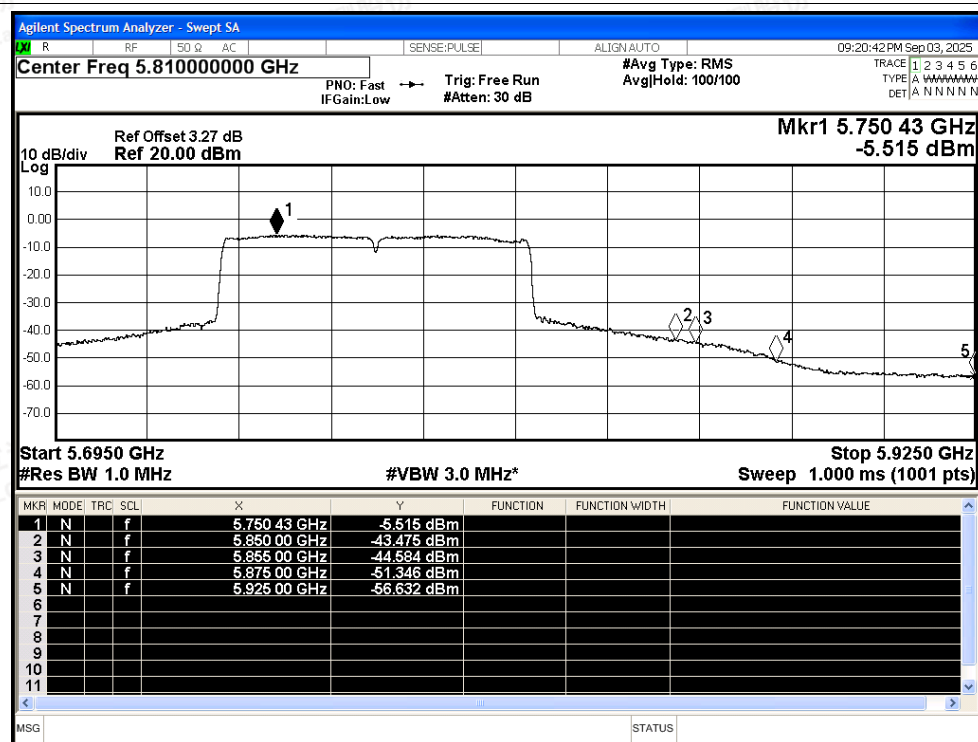

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT be80 5775MHz Ant4 Peak

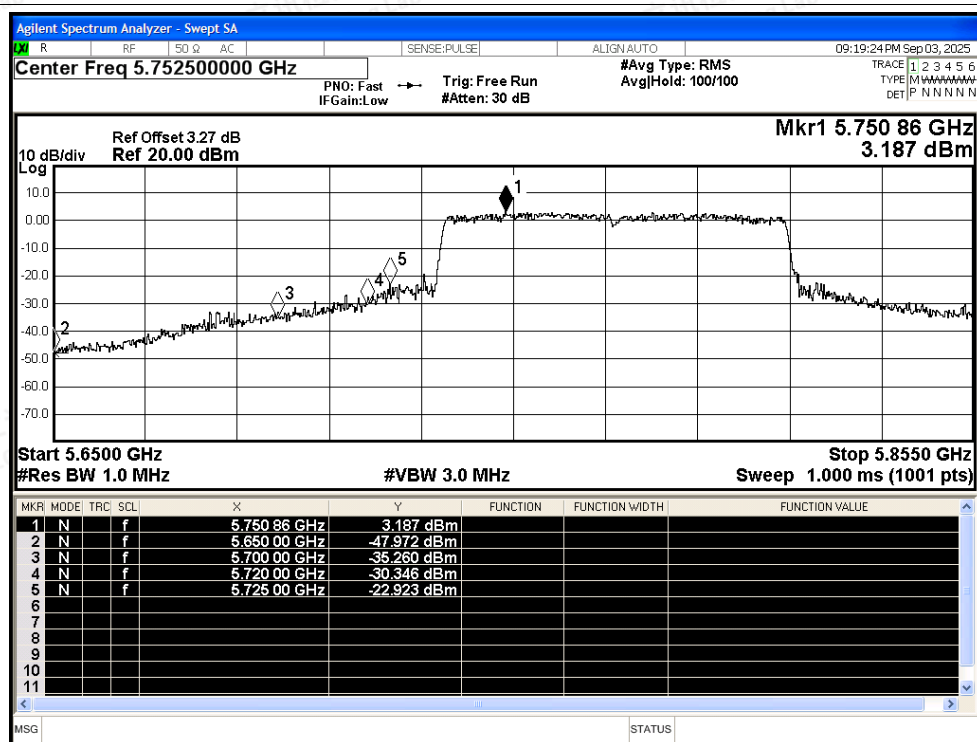

Restrict Band NVNT be80 5775MHz Ant4 Average

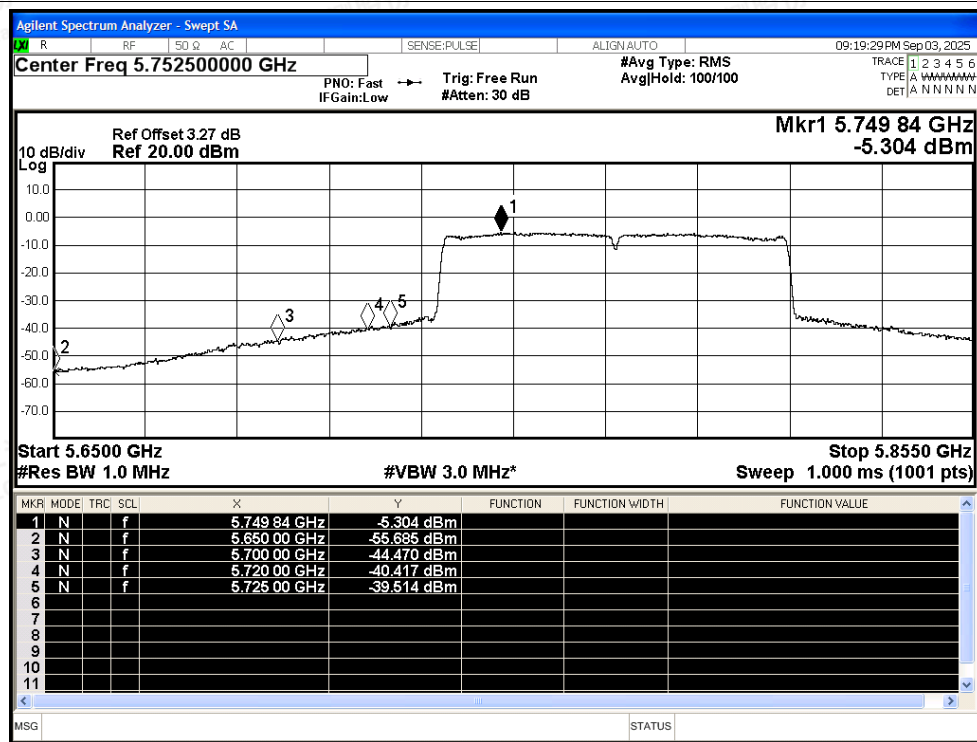

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant5	5650	-48.64	4.28	-	-44.36	Peak	-27	Pass
NVNT	a	5745	Ant5	5650	-56.47	4.28	0.24	-51.95	Average	-27	Pass
NVNT	a	5745	Ant5	5700	-47.19	4.28	-	-42.91	Peak	10	Pass
NVNT	a	5745	Ant5	5700	-54.84	4.28	0.24	-50.32	Average	10	Pass
NVNT	a	5745	Ant5	5720	-30.34	4.28	-	-26.06	Peak	15.6	Pass
NVNT	a	5745	Ant5	5720	-45.92	4.28	0.24	-41.40	Average	15.6	Pass
NVNT	a	5745	Ant5	5725	-26.57	4.28	-	-22.29	Peak	27	Pass
NVNT	a	5745	Ant5	5725	-41.07	4.28	0.24	-36.55	Average	27	Pass
NVNT	a	5825	Ant5	5850	-37.55	4.28	-	-33.27	Peak	27	Pass
NVNT	a	5825	Ant5	5850	-47.55	4.28	0.24	-43.03	Average	27	Pass
NVNT	a	5825	Ant5	5855	-41.73	4.28	-	-37.45	Peak	15.6	Pass
NVNT	a	5825	Ant5	5855	-52.16	4.28	0.24	-47.64	Average	15.6	Pass
NVNT	a	5825	Ant5	5875	-47.73	4.28	-	-43.45	Peak	10	Pass
NVNT	a	5825	Ant5	5875	-55.17	4.28	0.24	-50.65	Average	10	Pass
NVNT	a	5825	Ant5	5925	-48	4.28	-	-43.72	Peak	-27	Pass
NVNT	a	5825	Ant5	5925	-55.62	4.28	0.24	-51.10	Average	-27	Pass
NVNT	n20	5745	Ant5	5650	-46.9	4.28	-	-42.62	Peak	-27	Pass
NVNT	n20	5745	Ant5	5650	-56.64	4.28	0.12	-52.24	Average	-27	Pass
NVNT	n20	5745	Ant5	5700	-46.54	4.28	-	-42.26	Peak	10	Pass
NVNT	n20	5745	Ant5	5700	-54.25	4.28	0.12	-49.85	Average	10	Pass
NVNT	n20	5745	Ant5	5720	-33.18	4.28	-	-28.90	Peak	15.6	Pass
NVNT	n20	5745	Ant5	5720	-44.59	4.28	0.12	-40.19	Average	15.6	Pass
NVNT	n20	5745	Ant5	5725	-24.43	4.28	-	-20.15	Peak	27	Pass
NVNT	n20	5745	Ant5	5725	-39.28	4.28	0.12	-34.88	Average	27	Pass
NVNT	n20	5825	Ant5	5850	-29.39	4.28	-	-25.11	Peak	27	Pass
NVNT	n20	5825	Ant5	5850	-45.76	4.28	0.12	-41.36	Average	27	Pass
NVNT	n20	5825	Ant5	5855	-38.06	4.28	-	-33.78	Peak	15.6	Pass
NVNT	n20	5825	Ant5	5855	-52.36	4.28	0.12	-47.96	Average	15.6	Pass
NVNT	n20	5825	Ant5	5875	-45.9	4.28	-	-41.62	Peak	10	Pass
NVNT	n20	5825	Ant5	5875	-54.62	4.28	0.12	-50.22	Average	10	Pass
NVNT	n20	5825	Ant5	5925	-46.09	4.28	-	-41.81	Peak	-27	Pass
NVNT	n20	5825	Ant5	5925	-55.73	4.28	0.12	-51.33	Average	-27	Pass
NVNT	n40	5755	Ant5	5650	-48.36	4.28	-	-44.08	Peak	-27	Pass
NVNT	n40	5755	Ant5	5650	-56.47	4.28	0.24	-51.95	Average	-27	Pass
NVNT	n40	5755	Ant5	5700	-43.24	4.28	-	-38.96	Peak	10	Pass
NVNT	n40	5755	Ant5	5700	-52.85	4.28	0.24	-48.33	Average	10	Pass
NVNT	n40	5755	Ant5	5720	-31.4	4.28	-	-27.12	Peak	15.6	Pass





NVNT	n40	5755	Ant5	5720	-45.19	4.28	0.24	-40.67	Average	15.6	Pass
NVNT	n40	5755	Ant5	5725	-28.33	4.28	-	-24.05	Peak	27	Pass
NVNT	n40	5755	Ant5	5725	-40.29	4.28	0.24	-35.77	Average	27	Pass
NVNT	n40	5795	Ant5	5850	-46.18	4.28	-	-41.90	Peak	27	Pass
NVNT	n40	5795	Ant5	5850	-54.6	4.28	0.24	-50.08	Average	27	Pass
NVNT	n40	5795	Ant5	5855	-47.99	4.28	-	-43.71	Peak	15.6	Pass
NVNT	n40	5795	Ant5	5855	-55.24	4.28	0.24	-50.72	Average	15.6	Pass
NVNT	n40	5795	Ant5	5875	-50.44	4.28	-	-46.16	Peak	10	Pass
NVNT	n40	5795	Ant5	5875	-57.82	4.28	0.24	-53.30	Average	10	Pass
NVNT	n40	5795	Ant5	5925	-48.57	4.28	-	-44.29	Peak	-27	Pass
NVNT	n40	5795	Ant5	5925	-56.99	4.28	0.24	-52.47	Average	-27	Pass
NVNT	ac20	5745	Ant5	5650	-48.52	4.28	-	-44.24	Peak	-27	Pass
NVNT	ac20	5745	Ant5	5650	-56.64	4.28	0.12	-52.24	Average	-27	Pass
NVNT	ac20	5745	Ant5	5700	-46.01	4.28	-	-41.73	Peak	10	Pass
NVNT	ac20	5745	Ant5	5700	-54.51	4.28	0.12	-50.11	Average	10	Pass
NVNT	ac20	5745	Ant5	5720	-31.84	4.28	-	-27.56	Peak	15.6	Pass
NVNT	ac20	5745	Ant5	5720	-45.39	4.28	0.12	-40.99	Average	15.6	Pass
NVNT	ac20	5745	Ant5	5725	-21.42	4.28	-	-17.14	Peak	27	Pass
NVNT	ac20	5745	Ant5	5725	-38.63	4.28	0.12	-34.23	Average	27	Pass
NVNT	ac20	5825	Ant5	5850	-33.25	4.28	-	-28.97	Peak	27	Pass
NVNT	ac20	5825	Ant5	5850	-47.15	4.28	0.12	-42.75	Average	27	Pass
NVNT	ac20	5825	Ant5	5855	-40.35	4.28	-	-36.07	Peak	15.6	Pass
NVNT	ac20	5825	Ant5	5855	-51.5	4.28	0.12	-47.10	Average	15.6	Pass
NVNT	ac20	5825	Ant5	5875	-45.68	4.28	-	-41.40	Peak	10	Pass
NVNT	ac20	5825	Ant5	5875	-55.11	4.28	0.12	-50.71	Average	10	Pass
NVNT	ac20	5825	Ant5	5925	-47.4	4.28	-	-43.12	Peak	-27	Pass
NVNT	ac20	5825	Ant5	5925	-55.43	4.28	0.12	-51.03	Average	-27	Pass
NVNT	ac40	5755	Ant5	5650	-49.13	4.28	-	-44.85	Peak	-27	Pass
NVNT	ac40	5755	Ant5	5650	-56.98	4.28	0.24	-52.46	Average	-27	Pass
NVNT	ac40	5755	Ant5	5700	-42.86	4.28	-	-38.58	Peak	10	Pass
NVNT	ac40	5755	Ant5	5700	-52.88	4.28	0.24	-48.36	Average	10	Pass
NVNT	ac40	5755	Ant5	5720	-28.86	4.28	-	-24.58	Peak	15.6	Pass
NVNT	ac40	5755	Ant5	5720	-44.99	4.28	0.24	-40.47	Average	15.6	Pass
NVNT	ac40	5755	Ant5	5725	-18.91	4.28	-	-14.63	Peak	27	Pass
NVNT	ac40	5755	Ant5	5725	-41.59	4.28	0.24	-37.07	Average	27	Pass
NVNT	ac40	5795	Ant5	5850	-45.3	4.28	-	-41.02	Peak	27	Pass
NVNT	ac40	5795	Ant5	5850	-55.04	4.28	0.24	-50.52	Average	27	Pass
NVNT	ac40	5795	Ant5	5855	-47.35	4.28	-	-43.07	Peak	15.6	Pass
NVNT	ac40	5795	Ant5	5855	-55.87	4.28	0.24	-51.35	Average	15.6	Pass
NVNT	ac40	5795	Ant5	5875	-48.83	4.28	-	-44.55	Peak	10	Pass
NVNT	ac40	5795	Ant5	5875	-57.28	4.28	0.24	-52.76	Average	10	Pass





NVNT	ac40	5795	Ant5	5925	-49.33	4.28	-	-45.05	Peak	-27	Pass
NVNT	ac40	5795	Ant5	5925	-57.02	4.28	0.24	-52.50	Average	-27	Pass
NVNT	ac80	5775	Ant5	5850	-39.19	4.28	-	-34.91	Peak	27	Pass
NVNT	ac80	5775	Ant5	5850	-47.77	4.28	0.47	-43.02	Average	27	Pass
NVNT	ac80	5775	Ant5	5855	-38.81	4.28	-	-34.53	Peak	15.6	Pass
NVNT	ac80	5775	Ant5	5855	-49.21	4.28	0.47	-44.46	Average	15.6	Pass
NVNT	ac80	5775	Ant5	5875	-44.72	4.28	-	-40.44	Peak	10	Pass
NVNT	ac80	5775	Ant5	5875	-53.99	4.28	0.47	-49.24	Average	10	Pass
NVNT	ac80	5775	Ant5	5925	-48.64	4.28	-	-44.36	Peak	-27	Pass
NVNT	ac80	5775	Ant5	5925	-57.03	4.28	0.47	-52.28	Average	-27	Pass
NVNT	ac80	5775	Ant5	5650	-47.01	4.28	-	-42.73	Peak	-27	Pass
NVNT	ac80	5775	Ant5	5650	-55.22	4.28	0.47	-50.47	Average	-27	Pass
NVNT	ac80	5775	Ant5	5700	-40.43	4.28	-	-36.15	Peak	10	Pass
NVNT	ac80	5775	Ant5	5700	-48.95	4.28	0.47	-44.20	Average	10	Pass
NVNT	ac80	5775	Ant5	5720	-31.85	4.28	-	-27.57	Peak	15.6	Pass
NVNT	ac80	5775	Ant5	5720	-44	4.28	0.47	-39.25	Average	15.6	Pass
NVNT	ac80	5775	Ant5	5725	-30.5	4.28	-	-26.22	Peak	27	Pass
NVNT	ac80	5775	Ant5	5725	-42.18	4.28	0.47	-37.43	Average	27	Pass
NVNT	ax20	5745	Ant5	5650	-48.54	4.28	-	-44.26	Peak	-27	Pass
NVNT	ax20	5745	Ant5	5650	-56.53	4.28	0.12	-52.13	Average	-27	Pass
NVNT	ax20	5745	Ant5	5700	-46.34	4.28	-	-42.06	Peak	10	Pass
NVNT	ax20	5745	Ant5	5700	-54.41	4.28	0.12	-50.01	Average	10	Pass
NVNT	ax20	5745	Ant5	5720	-26.86	4.28	-	-22.58	Peak	15.6	Pass
NVNT	ax20	5745	Ant5	5720	-46.12	4.28	0.12	-41.72	Average	15.6	Pass
NVNT	ax20	5745	Ant5	5725	-23.71	4.28	-	-19.43	Peak	27	Pass
NVNT	ax20	5745	Ant5	5725	-38.61	4.28	0.12	-34.21	Average	27	Pass
NVNT	ax20	5825	Ant5	5850	-35.3	4.28	-	-31.02	Peak	27	Pass
NVNT	ax20	5825	Ant5	5850	-46.64	4.28	0.12	-42.24	Average	27	Pass
NVNT	ax20	5825	Ant5	5855	-38.67	4.28	-	-34.39	Peak	15.6	Pass
NVNT	ax20	5825	Ant5	5855	-51.87	4.28	0.12	-47.47	Average	15.6	Pass
NVNT	ax20	5825	Ant5	5875	-47.76	4.28	-	-43.48	Peak	10	Pass
NVNT	ax20	5825	Ant5	5875	-55.41	4.28	0.12	-51.01	Average	10	Pass
NVNT	ax20	5825	Ant5	5925	-48.84	4.28	-	-44.56	Peak	-27	Pass
NVNT	ax20	5825	Ant5	5925	-55.57	4.28	0.12	-51.17	Average	-27	Pass
NVNT	ax40	5755	Ant5	5650	-49.54	4.28	-	-45.26	Peak	-27	Pass
NVNT	ax40	5755	Ant5	5650	-56.65	4.28	0.23	-52.14	Average	-27	Pass
NVNT	ax40	5755	Ant5	5700	-45.58	4.28	-	-41.30	Peak	10	Pass
NVNT	ax40	5755	Ant5	5700	-52.84	4.28	0.23	-48.33	Average	10	Pass
NVNT	ax40	5755	Ant5	5720	-30.95	4.28	-	-26.67	Peak	15.6	Pass
NVNT	ax40	5755	Ant5	5720	-43.47	4.28	0.23	-38.96	Average	15.6	Pass
NVNT	ax40	5755	Ant5	5725	-22.3	4.28	-	-18.02	Peak	27	Pass





NVNT	ax40	5755	Ant5	5725	-41.03	4.28	0.23	-36.52	Average	27	Pass
NVNT	ax40	5795	Ant5	5850	-47.18	4.28	-	-42.90	Peak	27	Pass
NVNT	ax40	5795	Ant5	5850	-55	4.28	0.24	-50.48	Average	27	Pass
NVNT	ax40	5795	Ant5	5855	-45.53	4.28	-	-41.25	Peak	15.6	Pass
NVNT	ax40	5795	Ant5	5855	-55.61	4.28	0.24	-51.09	Average	15.6	Pass
NVNT	ax40	5795	Ant5	5875	-50.24	4.28	-	-45.96	Peak	10	Pass
NVNT	ax40	5795	Ant5	5875	-57.05	4.28	0.24	-52.53	Average	10	Pass
NVNT	ax40	5795	Ant5	5925	-50.16	4.28	-	-45.88	Peak	-27	Pass
NVNT	ax40	5795	Ant5	5925	-56.9	4.28	0.24	-52.38	Average	-27	Pass
NVNT	ax80	5775	Ant5	5850	-40.12	4.28	-	-35.84	Peak	27	Pass
NVNT	ax80	5775	Ant5	5850	-48.16	4.28	0.47	-43.41	Average	27	Pass
NVNT	ax80	5775	Ant5	5855	-39.2	4.28	-	-34.92	Peak	15.6	Pass
NVNT	ax80	5775	Ant5	5855	-49.48	4.28	0.47	-44.73	Average	15.6	Pass
NVNT	ax80	5775	Ant5	5875	-45.7	4.28	-	-41.42	Peak	10	Pass
NVNT	ax80	5775	Ant5	5875	-53.98	4.28	0.47	-49.23	Average	10	Pass
NVNT	ax80	5775	Ant5	5925	-48.91	4.28	-	-44.63	Peak	-27	Pass
NVNT	ax80	5775	Ant5	5925	-56.67	4.28	0.47	-51.92	Average	-27	Pass
NVNT	ax80	5775	Ant5	5650	-47.92	4.28	-	-43.64	Peak	-27	Pass
NVNT	ax80	5775	Ant5	5650	-55.49	4.28	0.47	-50.74	Average	-27	Pass
NVNT	ax80	5775	Ant5	5700	-39.92	4.28	-	-35.64	Peak	10	Pass
NVNT	ax80	5775	Ant5	5700	-49.07	4.28	0.47	-44.32	Average	10	Pass
NVNT	ax80	5775	Ant5	5720	-34.17	4.28	-	-29.89	Peak	15.6	Pass
NVNT	ax80	5775	Ant5	5720	-45.27	4.28	0.47	-40.52	Average	15.6	Pass
NVNT	ax80	5775	Ant5	5725	-28.33	4.28	-	-24.05	Peak	27	Pass
NVNT	ax80	5775	Ant5	5725	-43.51	4.28	0.47	-38.76	Average	27	Pass
NVNT	be20	5745	Ant5	5650	-49.62	4.28	-	-45.34	Peak	-27	Pass
NVNT	be20	5745	Ant5	5650	-56.91	4.28	0.12	-52.51	Average	-27	Pass
NVNT	be20	5745	Ant5	5700	-45.07	4.28	-	-40.79	Peak	10	Pass
NVNT	be20	5745	Ant5	5700	-54.39	4.28	0.12	-49.99	Average	10	Pass
NVNT	be20	5745	Ant5	5720	-30.57	4.28	-	-26.29	Peak	15.6	Pass
NVNT	be20	5745	Ant5	5720	-46.39	4.28	0.12	-41.99	Average	15.6	Pass
NVNT	be20	5745	Ant5	5725	-17.37	4.28	-	-13.09	Peak	27	Pass
NVNT	be20	5745	Ant5	5725	-38.84	4.28	0.12	-34.44	Average	27	Pass
NVNT	be20	5825	Ant5	5850	-33.23	4.28	-	-28.95	Peak	27	Pass
NVNT	be20	5825	Ant5	5850	-47.35	4.28	0.12	-42.95	Average	27	Pass
NVNT	be20	5825	Ant5	5855	-39.92	4.28	-	-35.64	Peak	15.6	Pass
NVNT	be20	5825	Ant5	5855	-51.92	4.28	0.12	-47.52	Average	15.6	Pass
NVNT	be20	5825	Ant5	5875	-46.94	4.28	-	-42.66	Peak	10	Pass
NVNT	be20	5825	Ant5	5875	-55.14	4.28	0.12	-50.74	Average	10	Pass
NVNT	be20	5825	Ant5	5925	-47.44	4.28	-	-43.16	Peak	-27	Pass
NVNT	be20	5825	Ant5	5925	-55.61	4.28	0.12	-51.21	Average	-27	Pass






NVNT	be40	5755	Ant5	5650	-49.31	4.28	-	-45.03	Peak	-27	Pass
NVNT	be40	5755	Ant5	5650	-56.82	4.28	0.24	-52.30	Average	-27	Pass
NVNT	be40	5755	Ant5	5700	-43.54	4.28	-	-39.26	Peak	10	Pass
NVNT	be40	5755	Ant5	5700	-52.95	4.28	0.24	-48.43	Average	10	Pass
NVNT	be40	5755	Ant5	5720	-28.29	4.28	-	-24.01	Peak	15.6	Pass
NVNT	be40	5755	Ant5	5720	-42.58	4.28	0.24	-38.06	Average	15.6	Pass
NVNT	be40	5755	Ant5	5725	-26.04	4.28	-	-21.76	Peak	27	Pass
NVNT	be40	5755	Ant5	5725	-42.32	4.28	0.24	-37.80	Average	27	Pass
NVNT	be40	5795	Ant5	5850	-46.3	4.28	-	-42.02	Peak	27	Pass
NVNT	be40	5795	Ant5	5850	-54.87	4.28	0.24	-50.35	Average	27	Pass
NVNT	be40	5795	Ant5	5855	-47.42	4.28	-	-43.14	Peak	15.6	Pass
NVNT	be40	5795	Ant5	5855	-55.58	4.28	0.24	-51.06	Average	15.6	Pass
NVNT	be40	5795	Ant5	5875	-49.52	4.28	-	-45.24	Peak	10	Pass
NVNT	be40	5795	Ant5	5875	-57.31	4.28	0.24	-52.79	Average	10	Pass
NVNT	be40	5795	Ant5	5925	-48.27	4.28	-	-43.99	Peak	-27	Pass
NVNT	be40	5795	Ant5	5925	-57.23	4.28	0.24	-52.71	Average	-27	Pass
NVNT	be80	5775	Ant5	5850	-39.84	4.28	-	-35.56	Peak	27	Pass
NVNT	be80	5775	Ant5	5850	-48.24	4.28	0.47	-43.49	Average	27	Pass
NVNT	be80	5775	Ant5	5855	-39.87	4.28	-	-35.59	Peak	15.6	Pass
NVNT	be80	5775	Ant5	5855	-48.99	4.28	0.47	-44.24	Average	15.6	Pass
NVNT	be80	5775	Ant5	5875	-43.36	4.28	-	-39.08	Peak	10	Pass
NVNT	be80	5775	Ant5	5875	-53.32	4.28	0.47	-48.57	Average	10	Pass
NVNT	be80	5775	Ant5	5925	-49.15	4.28	-	-44.87	Peak	-27	Pass
NVNT	be80	5775	Ant5	5925	-57.09	4.28	0.47	-52.34	Average	-27	Pass
NVNT	be80	5775	Ant5	5650	-48.35	4.28	-	-44.07	Peak	-27	Pass
NVNT	be80	5775	Ant5	5650	-55.64	4.28	0.47	-50.89	Average	-27	Pass
NVNT	be80	5775	Ant5	5700	-38.51	4.28	-	-34.23	Peak	10	Pass
NVNT	be80	5775	Ant5	5700	-49.02	4.28	0.47	-44.27	Average	10	Pass
NVNT	be80	5775	Ant5	5720	-32.64	4.28	-	-28.36	Peak	15.6	Pass
NVNT	be80	5775	Ant5	5720	-44.35	4.28	0.47	-39.60	Average	15.6	Pass
NVNT	be80	5775	Ant5	5725	-27.11	4.28	-	-22.83	Peak	27	Pass
NVNT	be80	5775	Ant5	5725	-42.93	4.28	0.47	-38.18	Average	27	Pass






Test Graphs

Restrict Band NVNT a 5745MHz Ant5 Peak

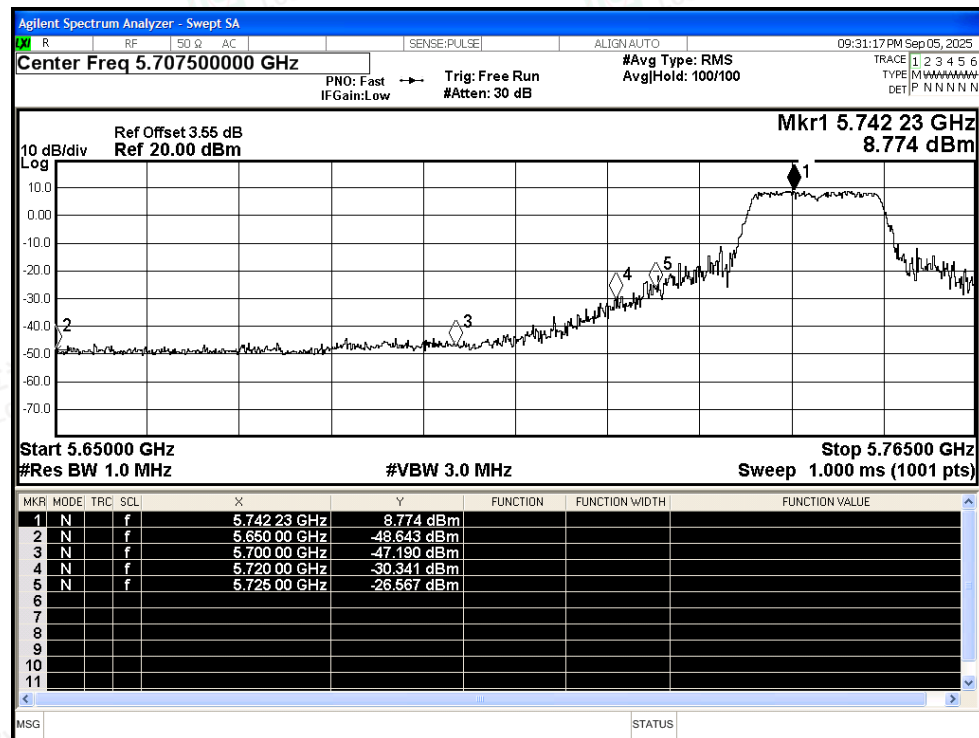

Restrict Band NVNT a 5745MHz Ant5 Average

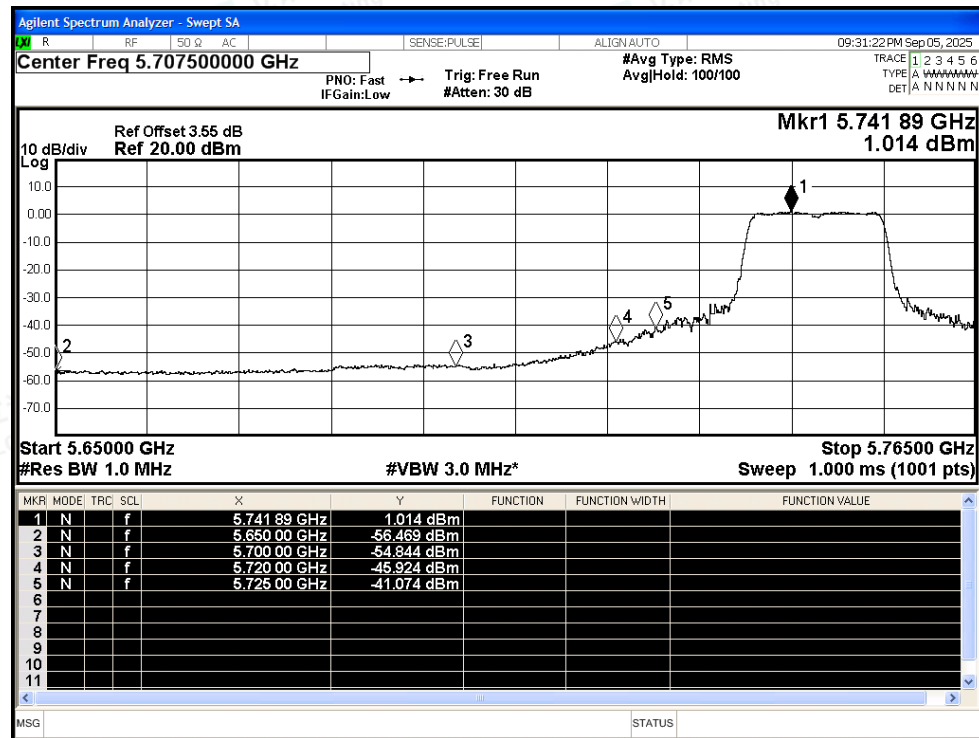

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant5 Peak

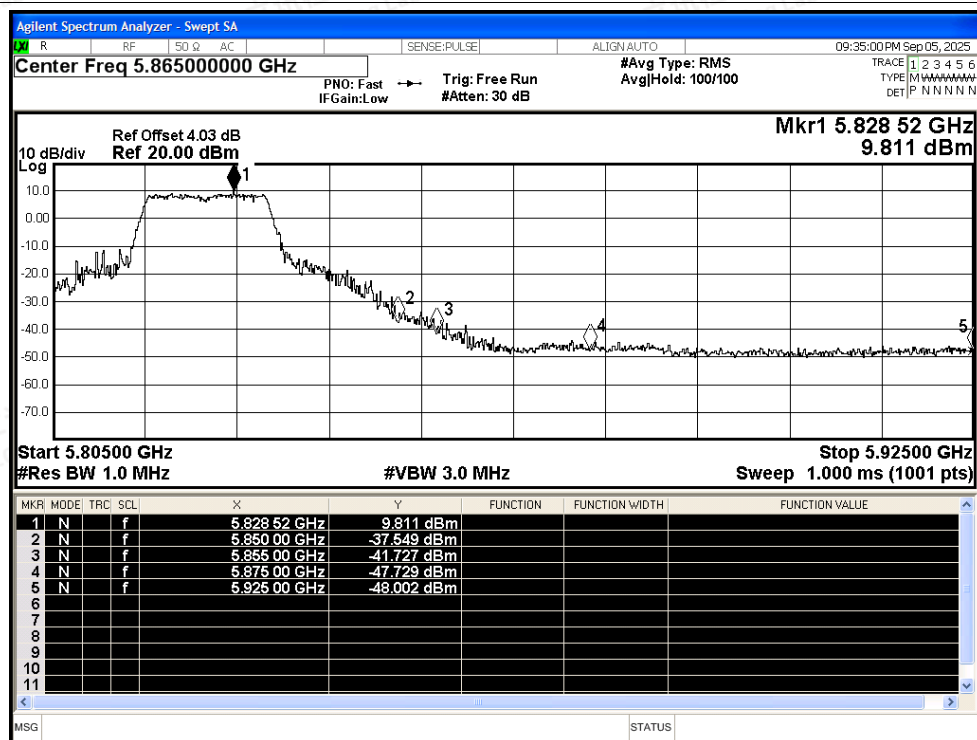

Restrict Band NVNT a 5825MHz Ant5 Average

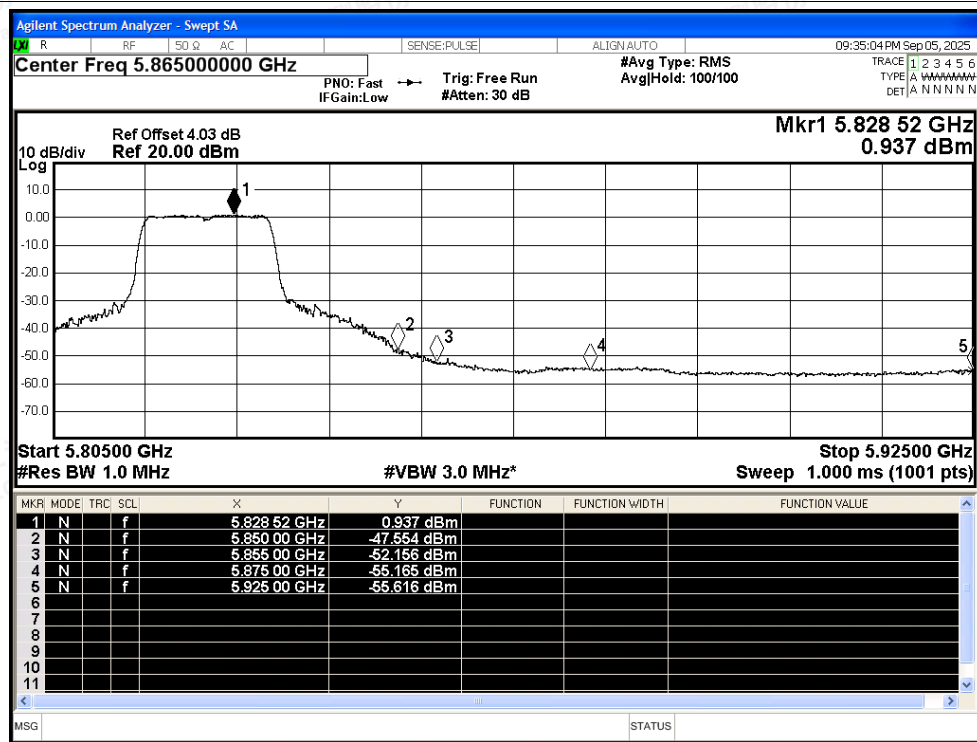

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5745MHz Ant5 Peak

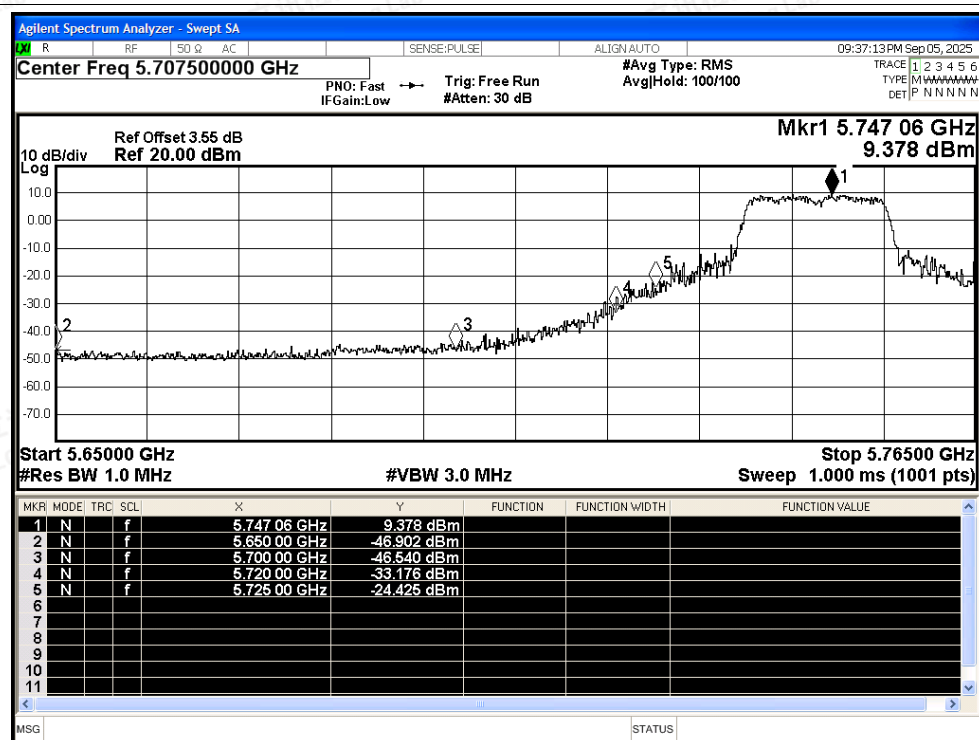

Restrict Band NVNT n20 5745MHz Ant5 Average

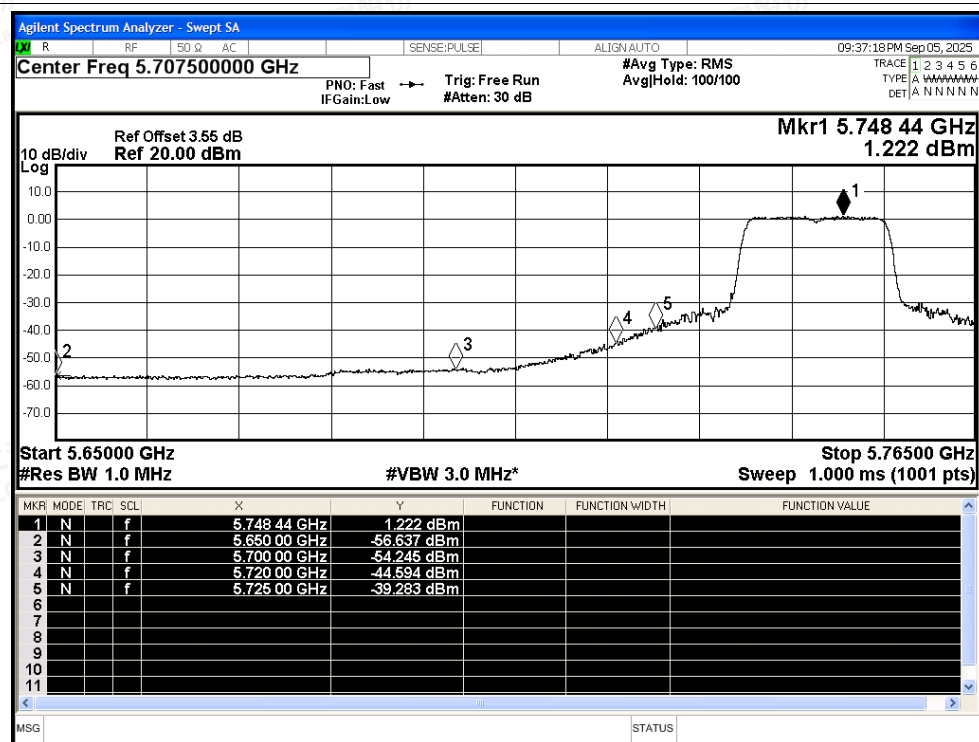

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant5 Peak

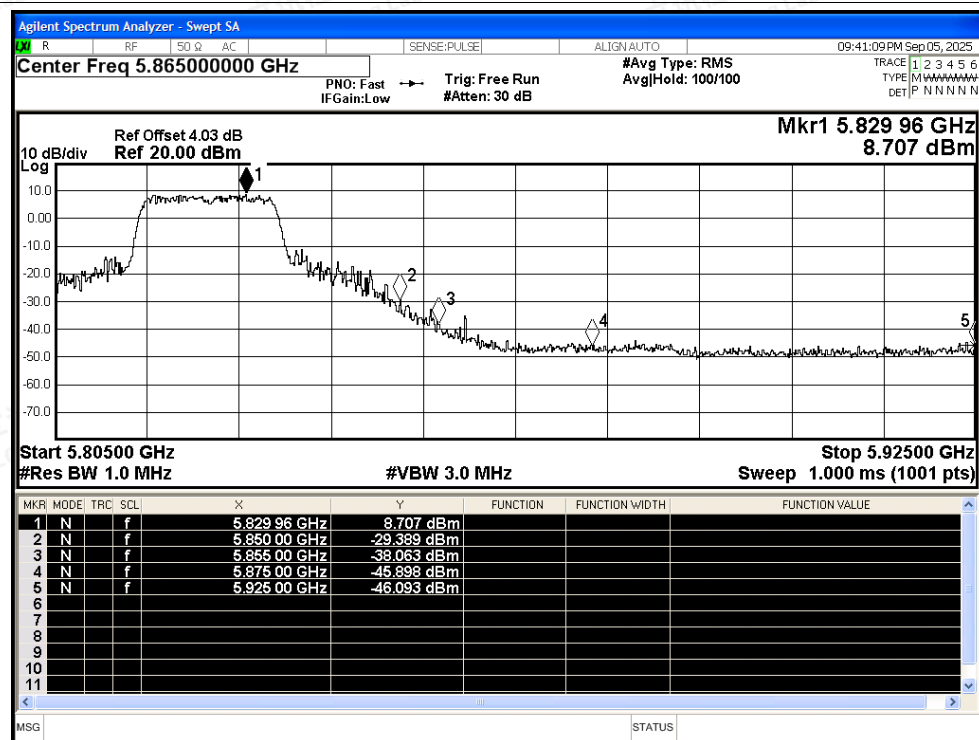


Restrict Band NVNT n20 5825MHz Ant5 Average

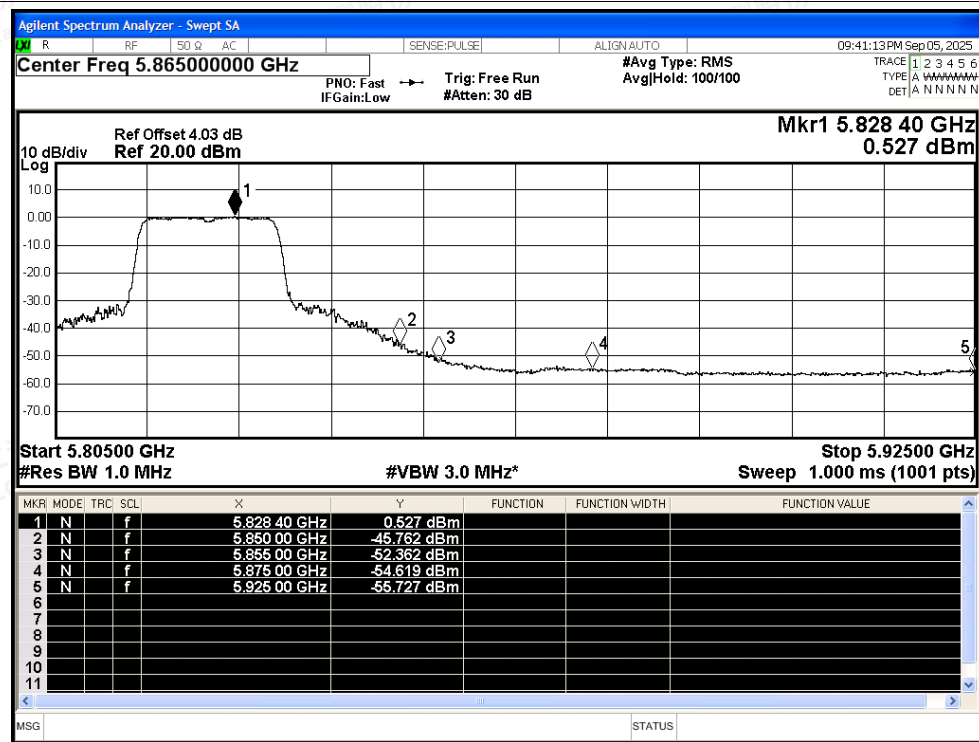




Restrict Band NVNT n40 5755MHz Ant5 Peak

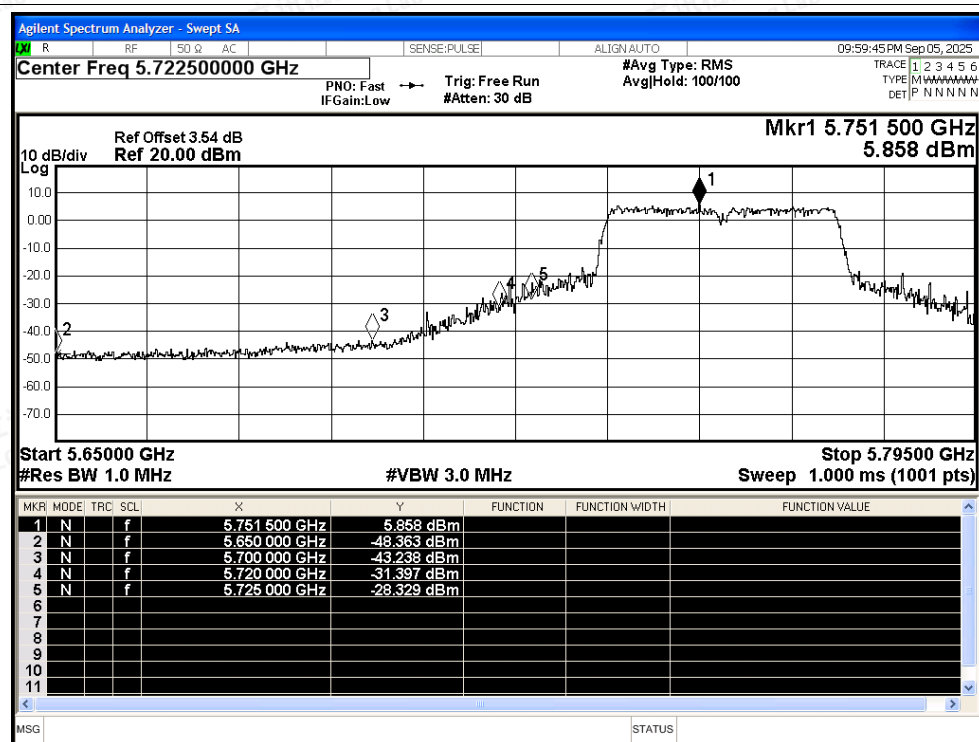

Restrict Band NVNT n40 5755MHz Ant5 Average

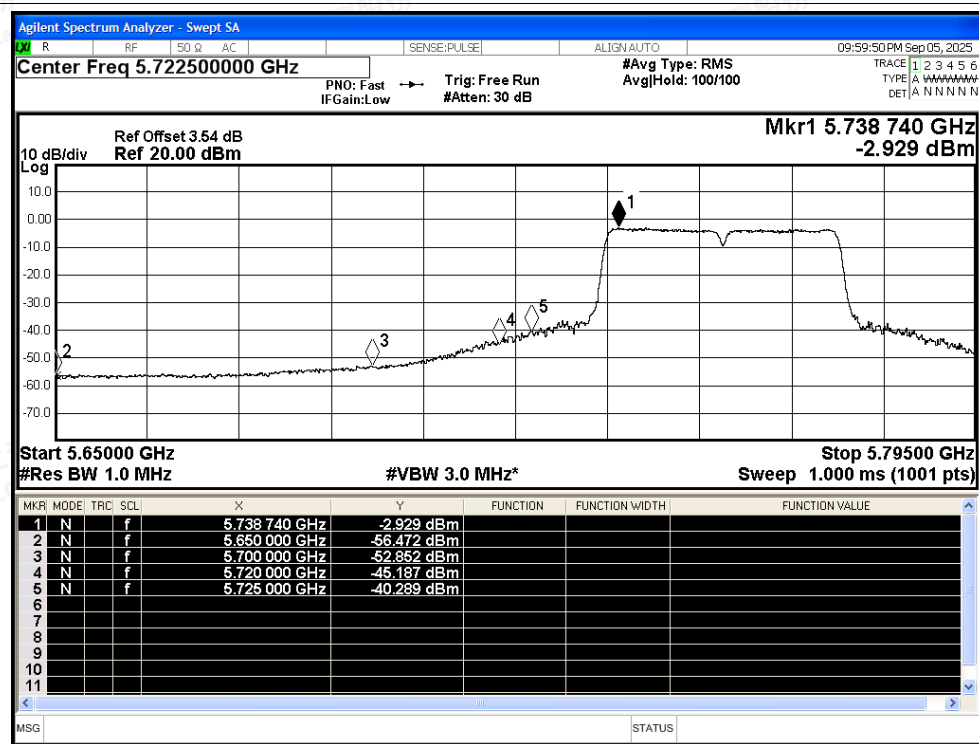

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant5 Peak

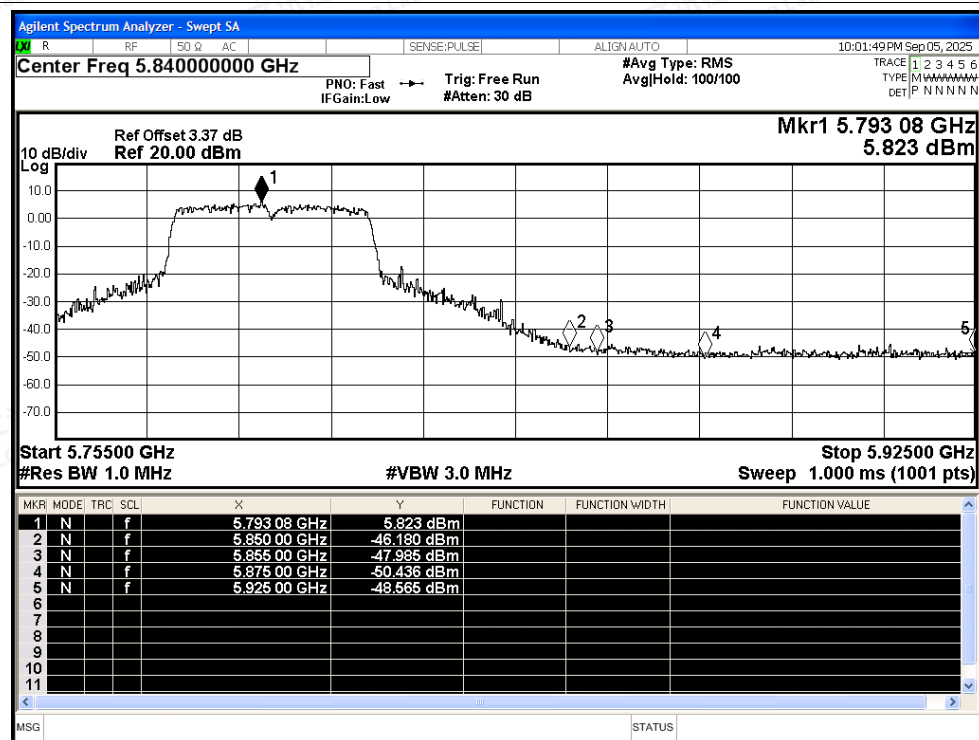

Restrict Band NVNT n40 5795MHz Ant5 Average

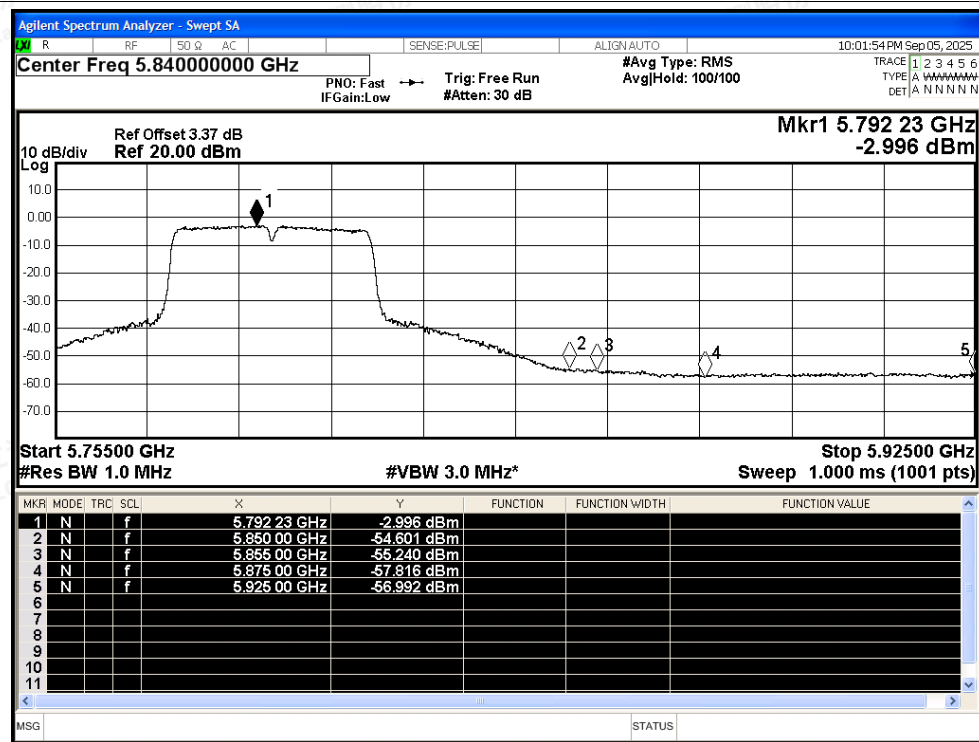

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant5 Peak

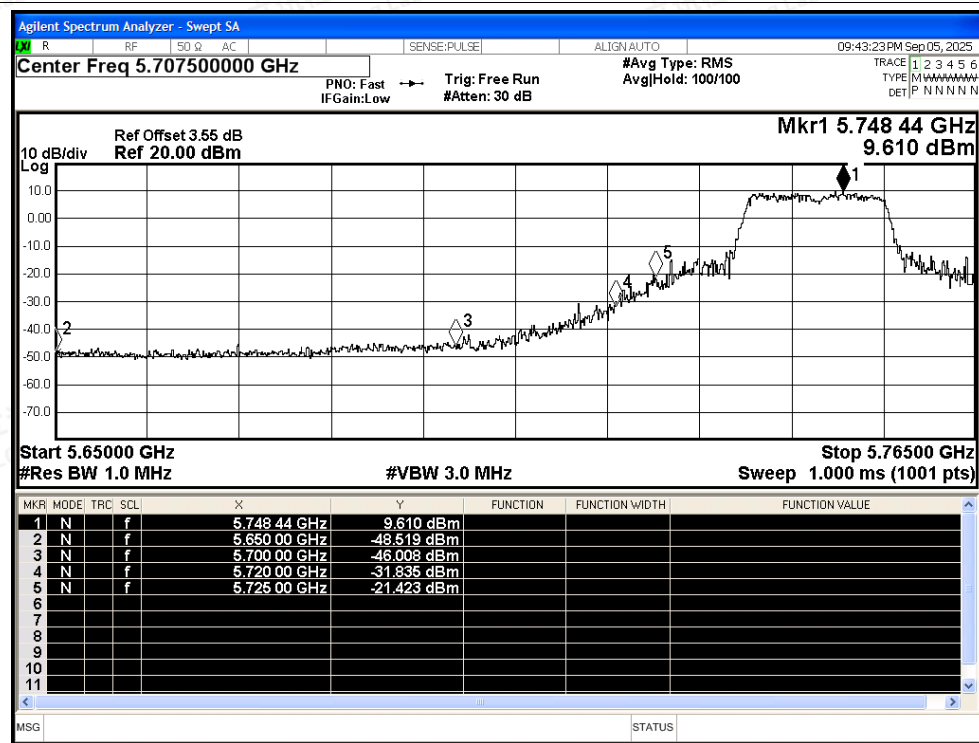

Restrict Band NVNT ac20 5745MHz Ant5 Average

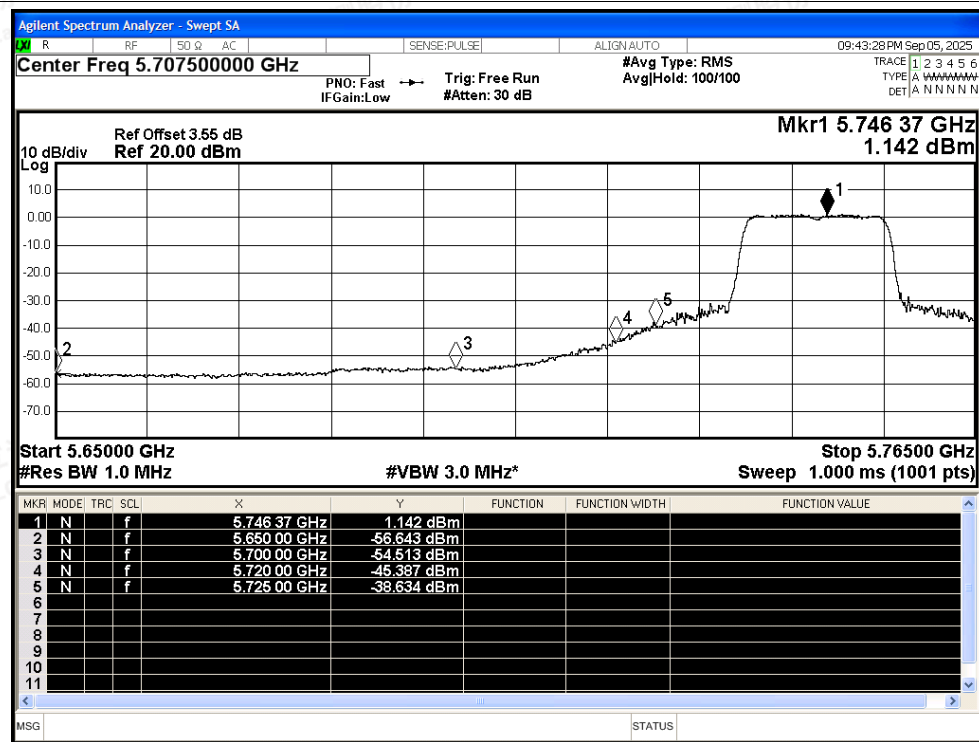

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant5 Peak

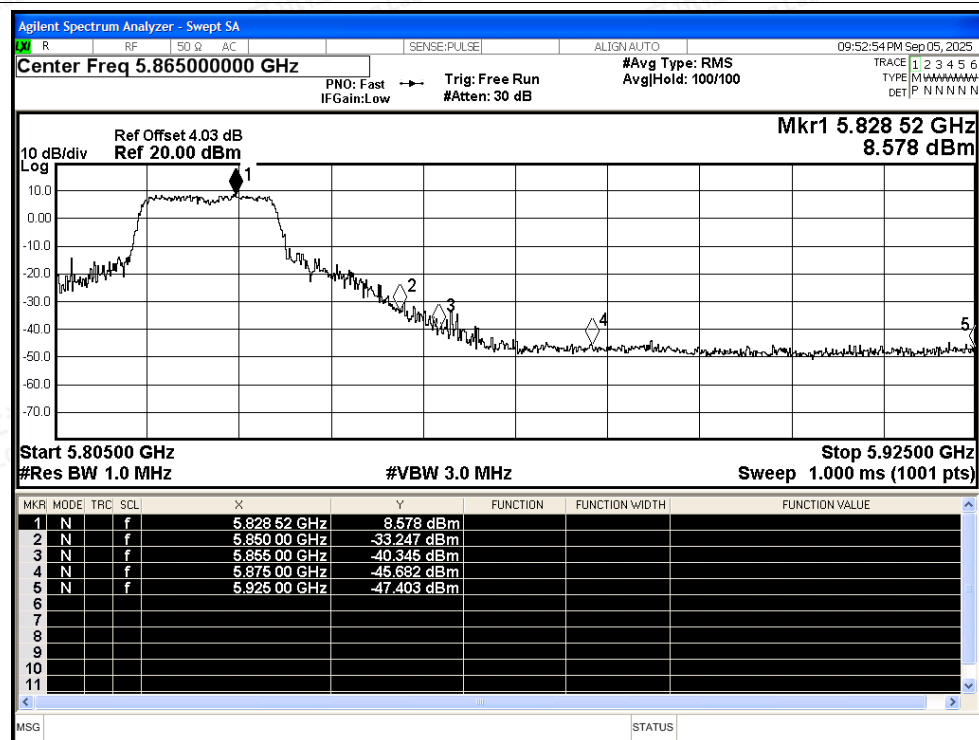

Restrict Band NVNT ac20 5825MHz Ant5 Average

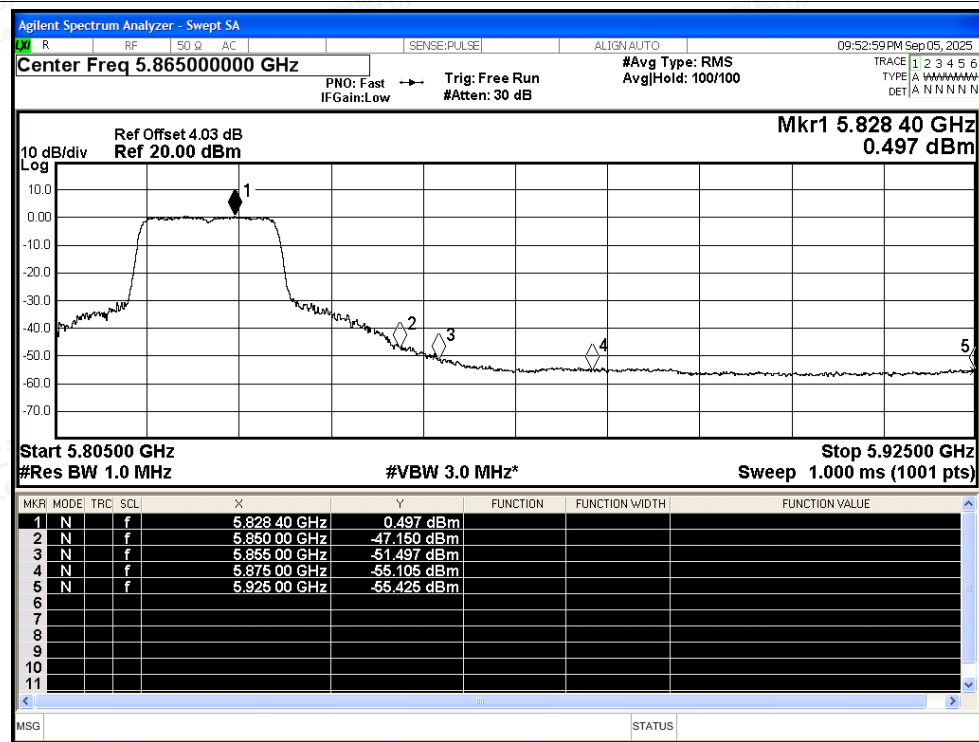

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant5 Peak

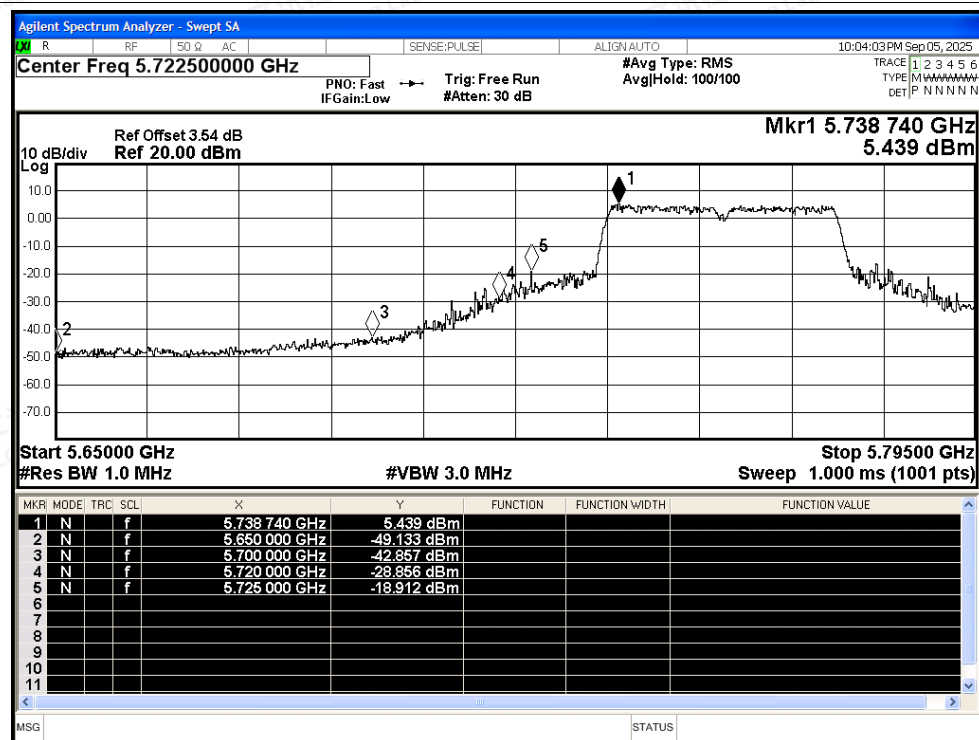

Restrict Band NVNT ac40 5755MHz Ant5 Average

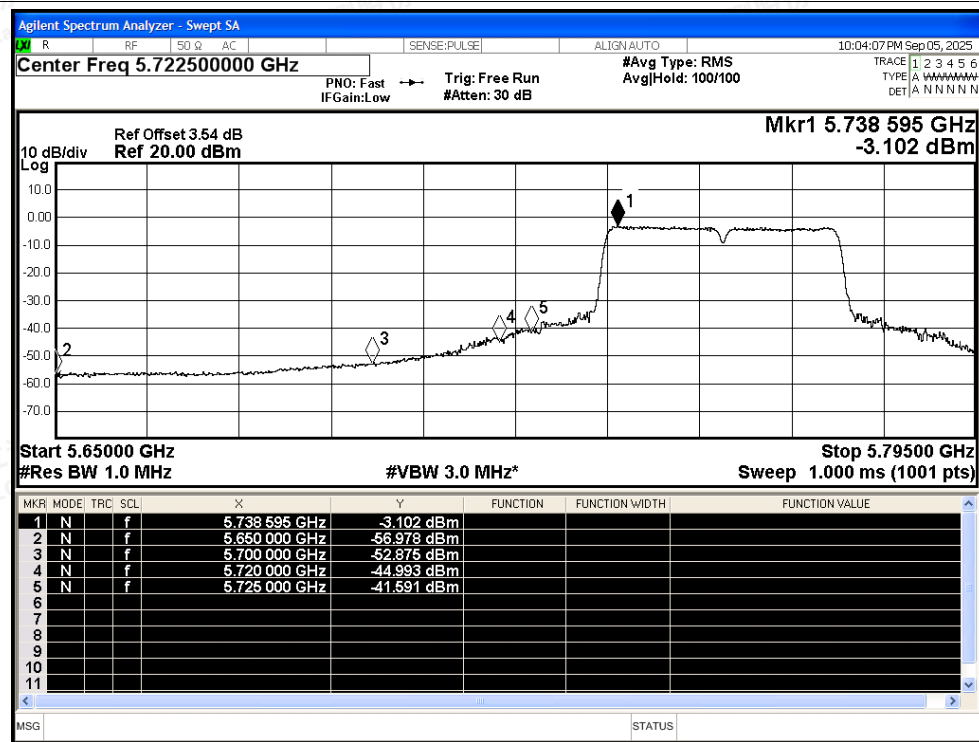

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant5 Peak

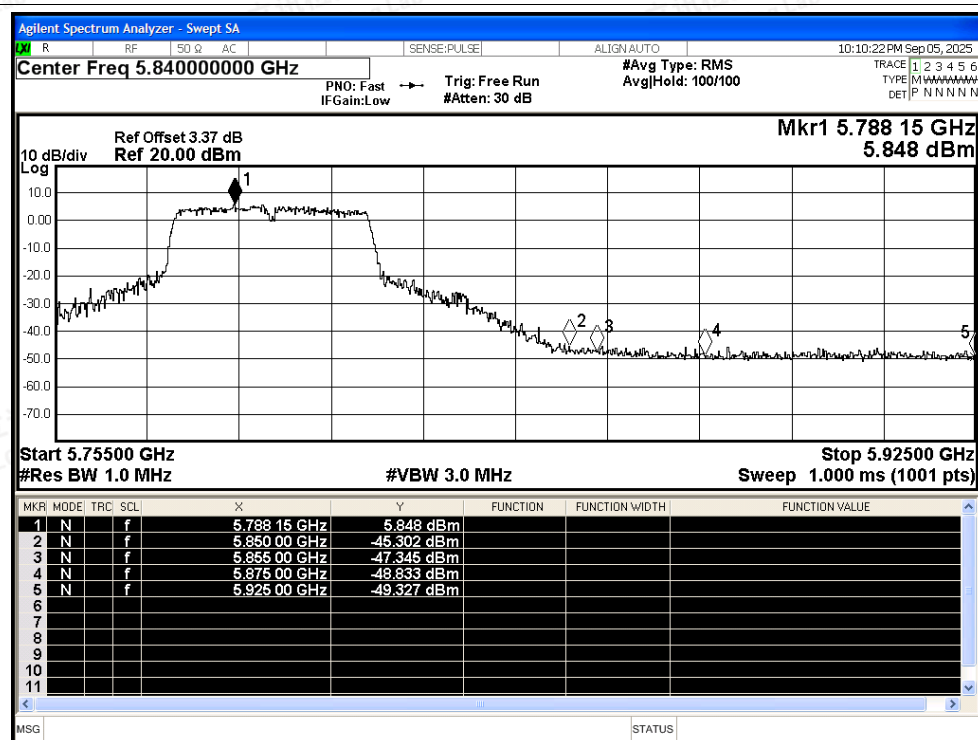

Restrict Band NVNT ac40 5795MHz Ant5 Average

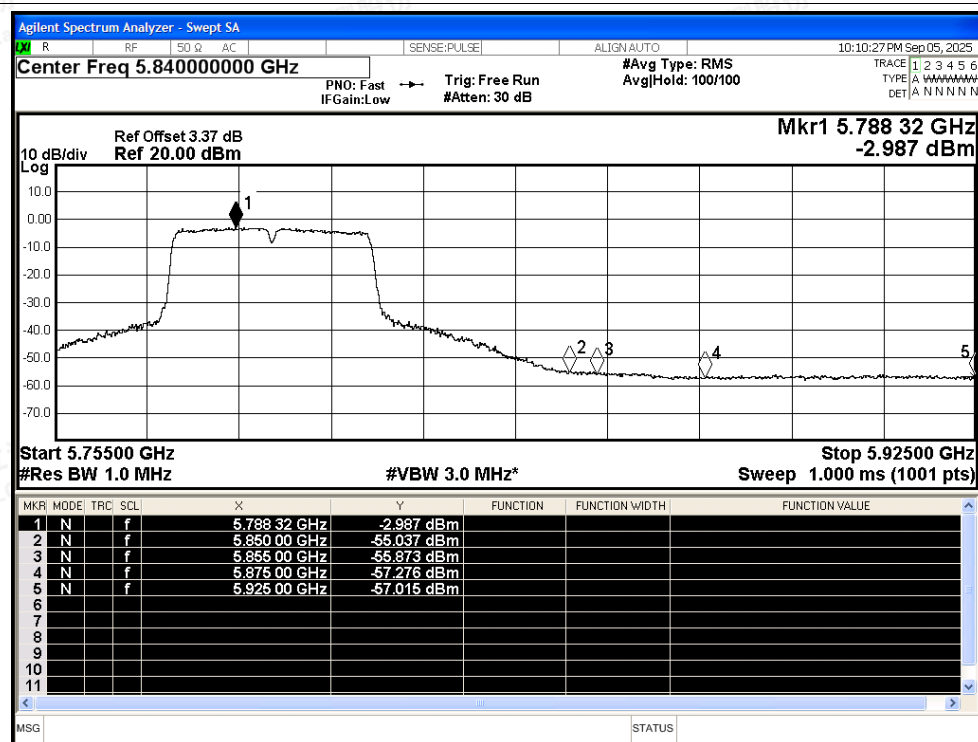

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant5 Peak

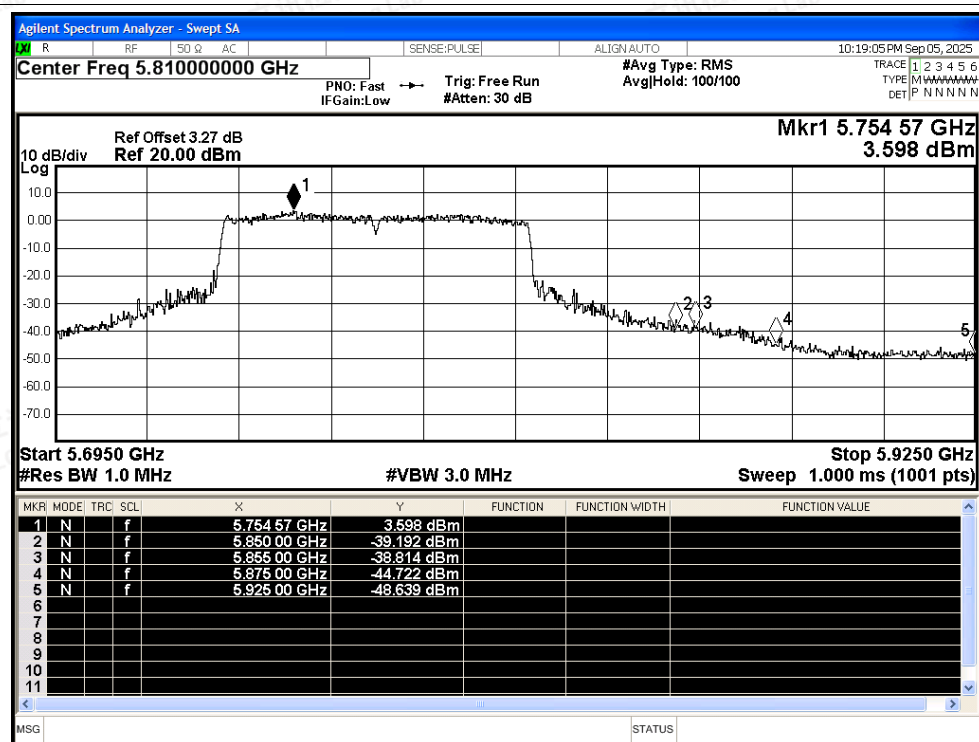


Restrict Band NVNT ac80 5775MHz Ant5 Average

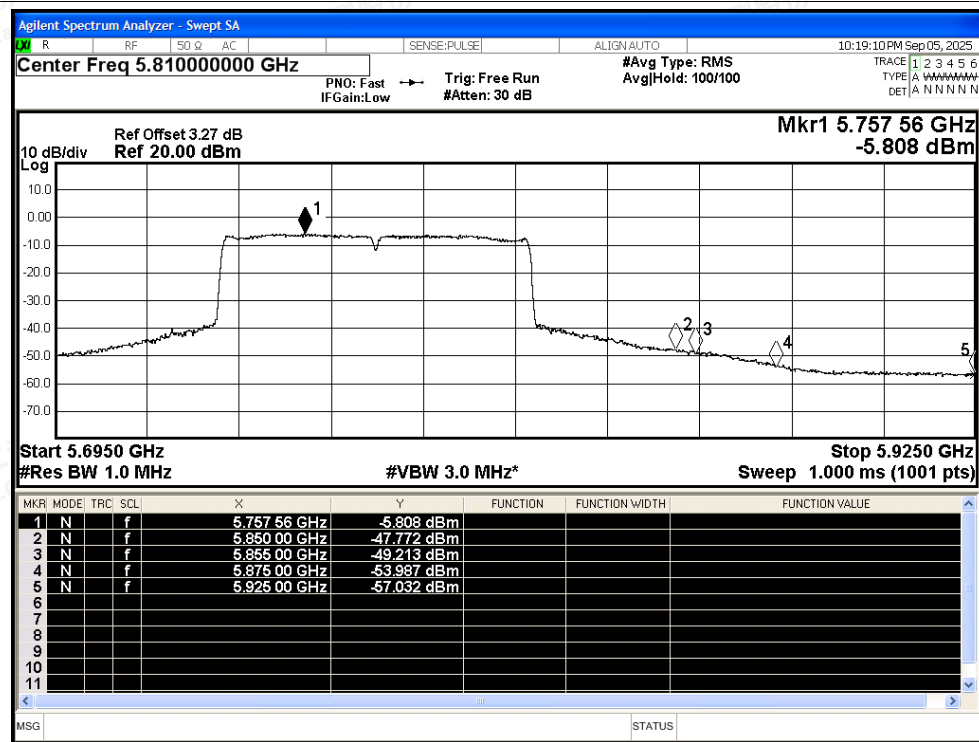




Restrict Band NVNT ac80 5775MHz Ant5 Peak

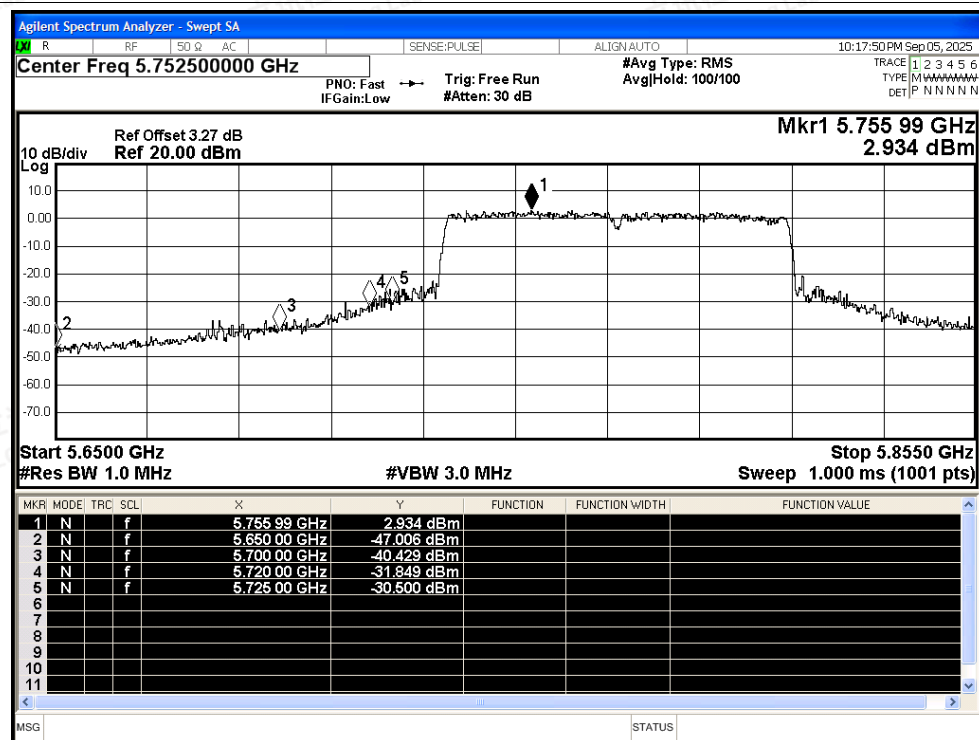

Restrict Band NVNT ac80 5775MHz Ant5 Average

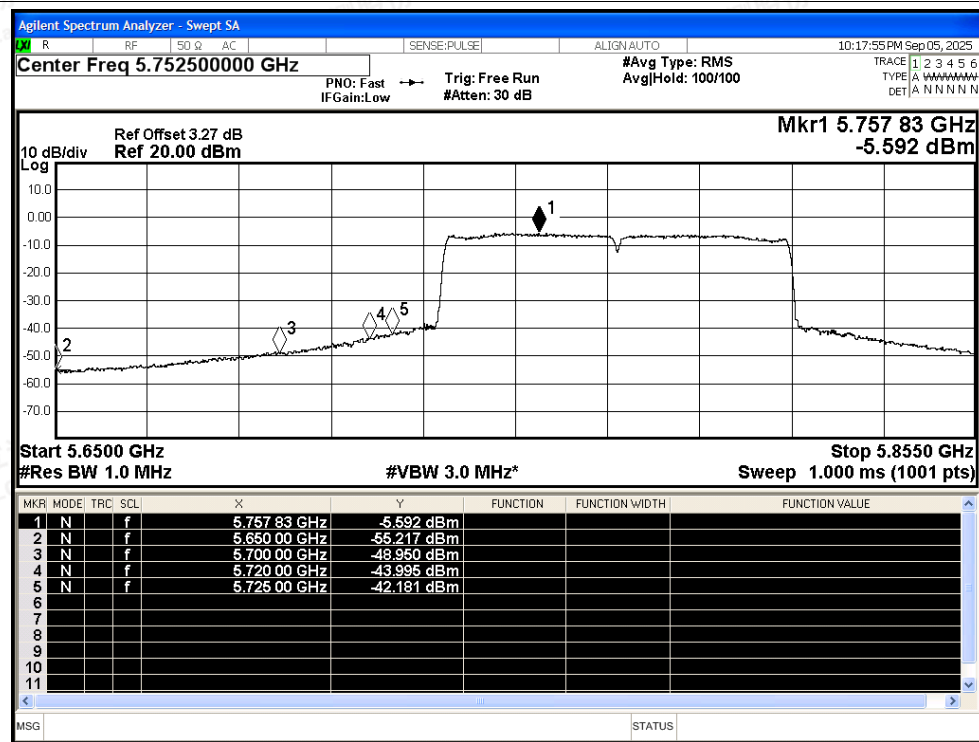

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity