

Appendix B

RF Test Data for 5.2GWIFI (Conducted Measurement)

Product Name: AX3000 Indoor/Outdoor Wi-Fi Access Point

Test Model: OAP3000

Environmental Conditions

Temperature:	24.4°C
Relative Humidity:	53.9%
ATM Pressure:	100.0 kPa
Test Engineer:	Jay Luo
Supervised by:	Paddi Chen



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



B.1 -26dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Limit -26 dB Bandwidth (MHz)	Verdict
NVNT	a	5180	Ant1	20.968	---	Pass
NVNT	a	5200	Ant1	19.976	---	Pass
NVNT	a	5240	Ant1	22.679	---	Pass
NVNT	n20	5180	Ant1	20.025	---	Pass
NVNT	n20	5200	Ant1	20.955	---	Pass
NVNT	n20	5240	Ant1	21.471	---	Pass
NVNT	n40	5190	Ant1	40.516	---	Pass
NVNT	n40	5230	Ant1	40.705	---	Pass
NVNT	ac20	5180	Ant1	22.191	---	Pass
NVNT	ac20	5200	Ant1	22.927	---	Pass
NVNT	ac20	5240	Ant1	23.826	---	Pass
NVNT	ac40	5190	Ant1	40.747	---	Pass
NVNT	ac40	5230	Ant1	40.584	---	Pass
NVNT	ac80	5210	Ant1	80.768	---	Pass
NVNT	ax20	5180	Ant1	20.391	---	Pass
NVNT	ax20	5200	Ant1	20.152	---	Pass
NVNT	ax20	5240	Ant1	20.26	---	Pass
NVNT	ax40	5190	Ant1	40.948	---	Pass
NVNT	ax40	5230	Ant1	40.663	---	Pass
NVNT	ax80	5210	Ant1	80.867	---	Pass
NVNT	ac160	5250	Ant1	225.42	---	Pass
NVNT	ax160	5250	Ant1	222.645	---	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

-26dB Bandwidth NVNT a 5180MHz Ant1

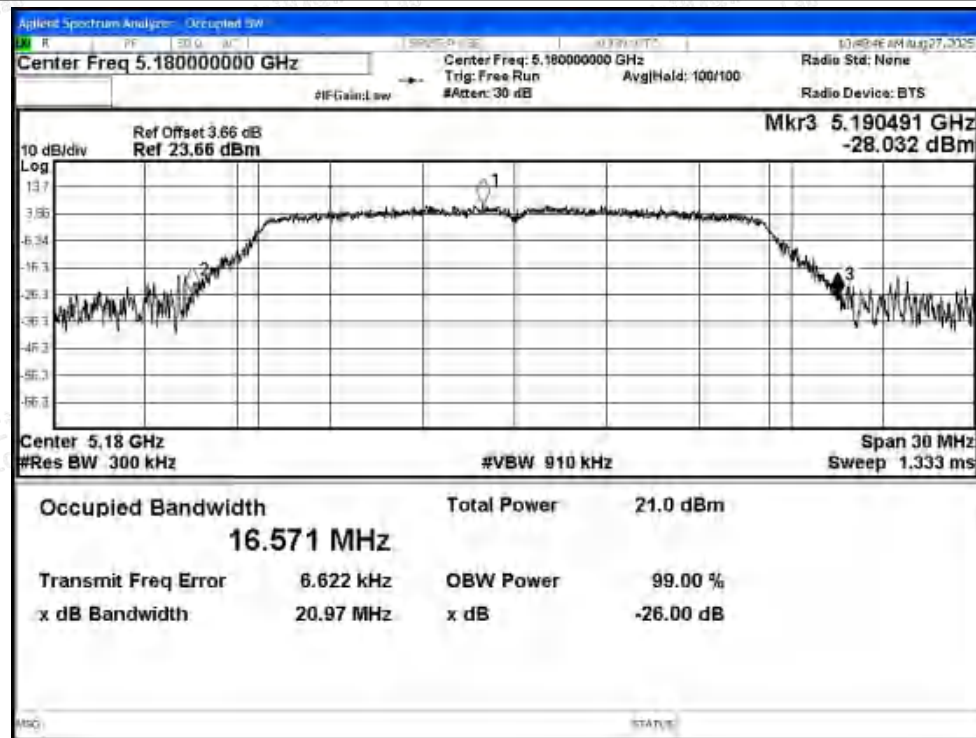

-26dB Bandwidth NVNT a 5200MHz Ant1

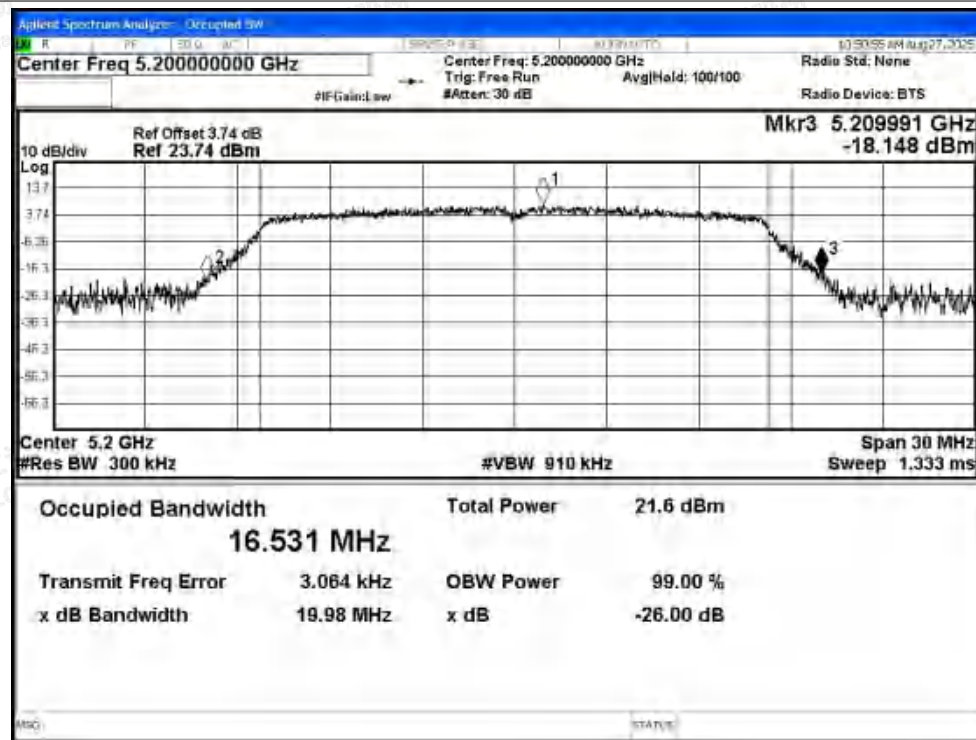

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT a 5240MHz Ant1

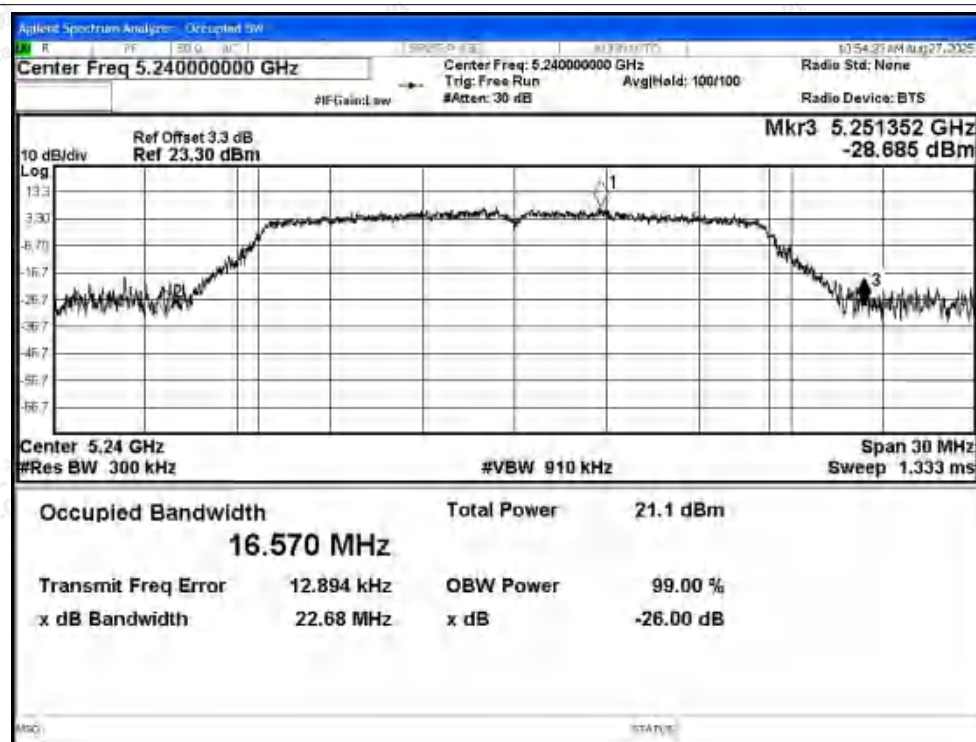

-26dB Bandwidth NVNT n20 5180MHz Ant1

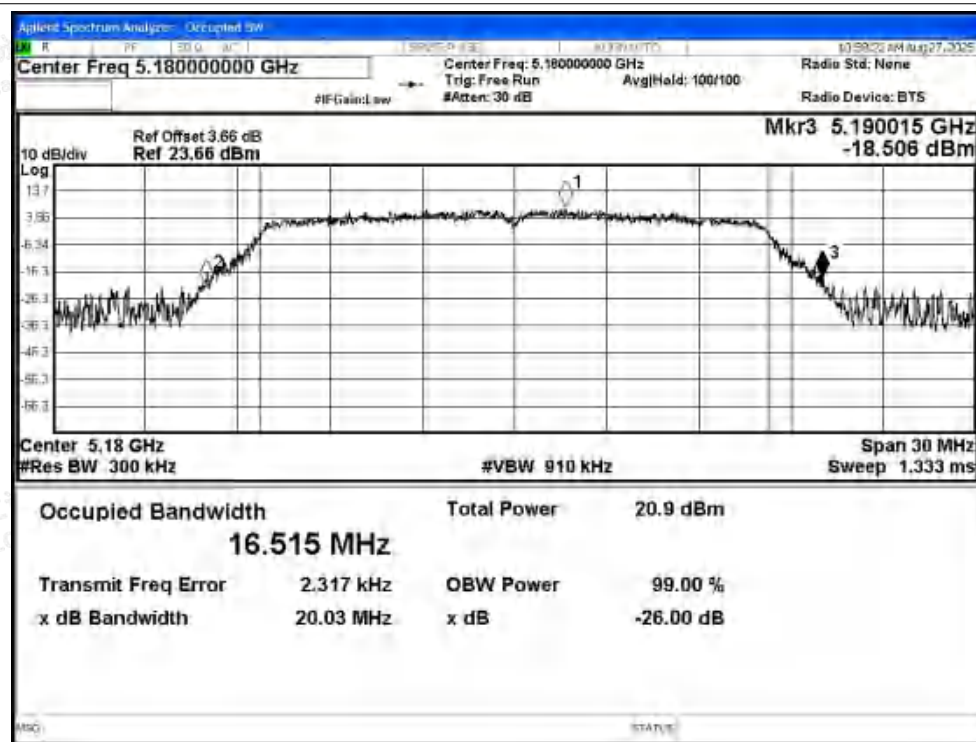

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT n20 5200MHz Ant1

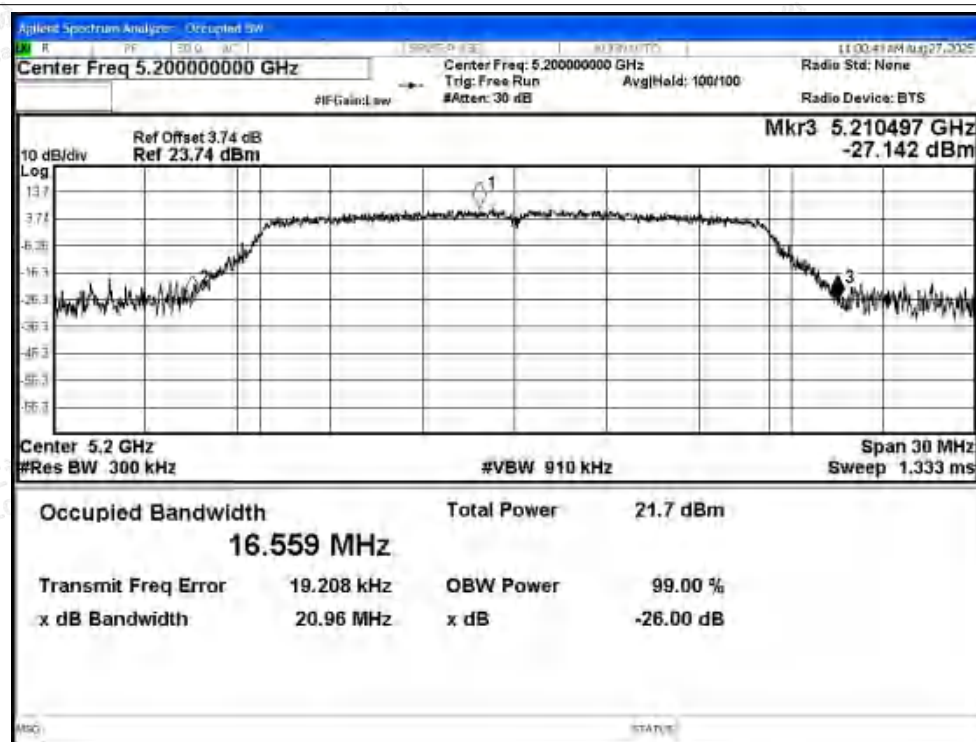

-26dB Bandwidth NVNT n20 5240MHz Ant1

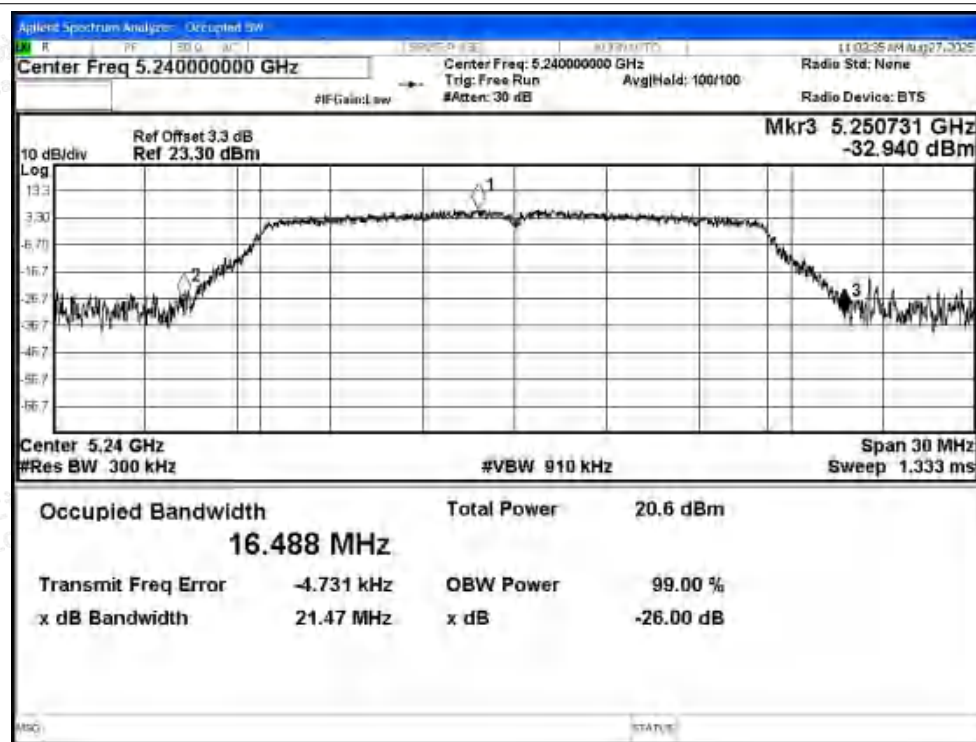

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-26dB Bandwidth NVNT n40 5190MHz Ant1

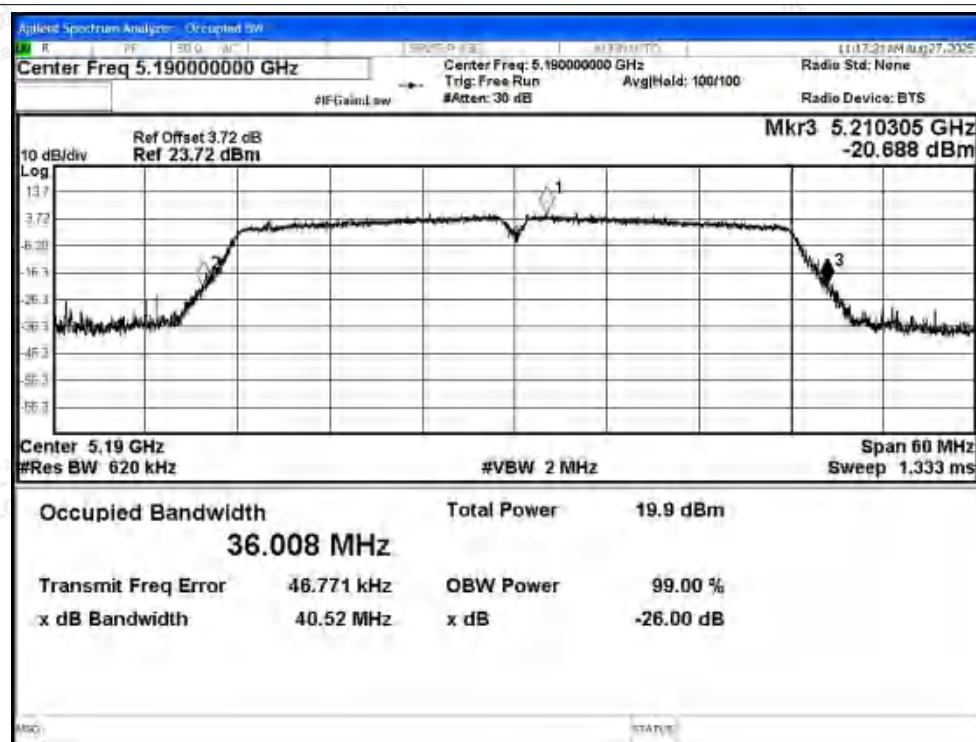

-26dB Bandwidth NVNT n40 5230MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac20 5180MHz Ant1

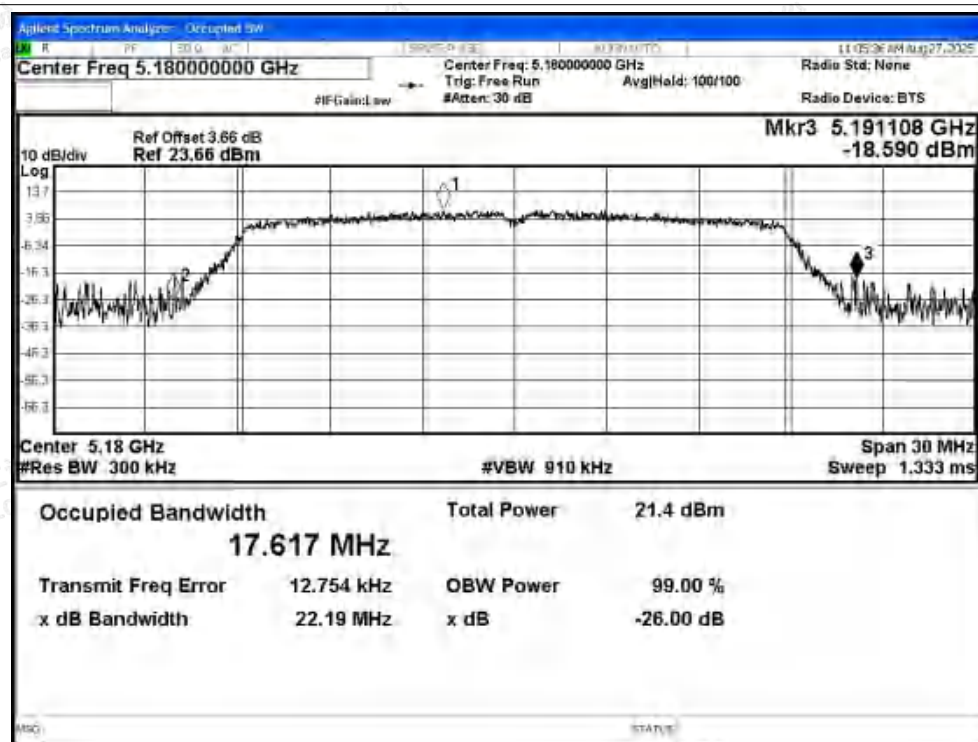

-26dB Bandwidth NVNT ac20 5200MHz Ant1

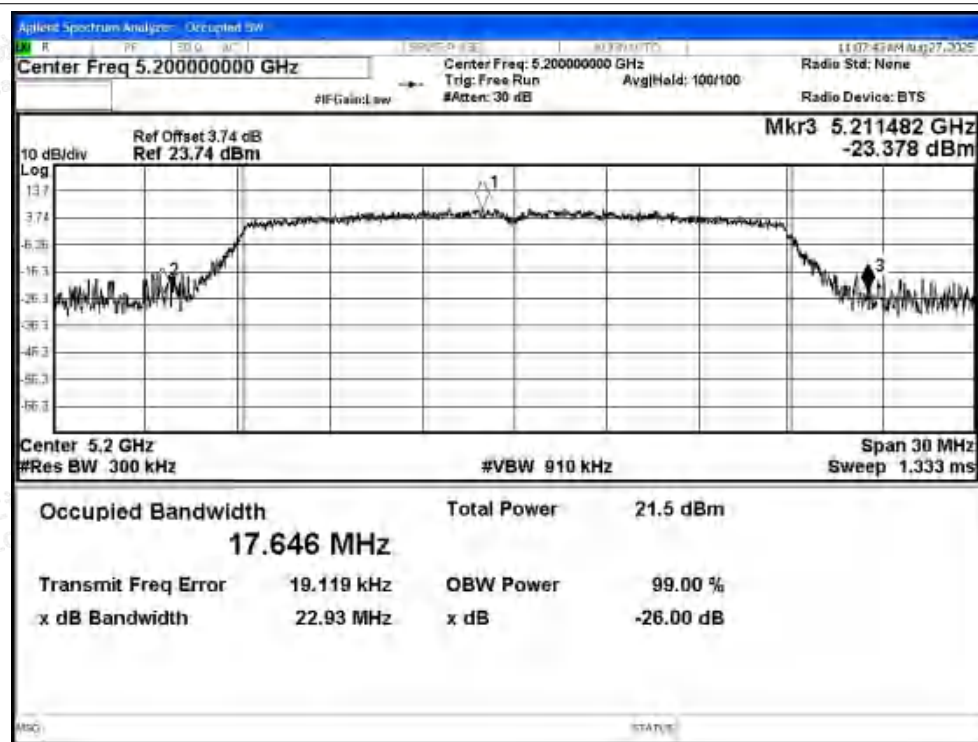

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac20 5240MHz Ant1

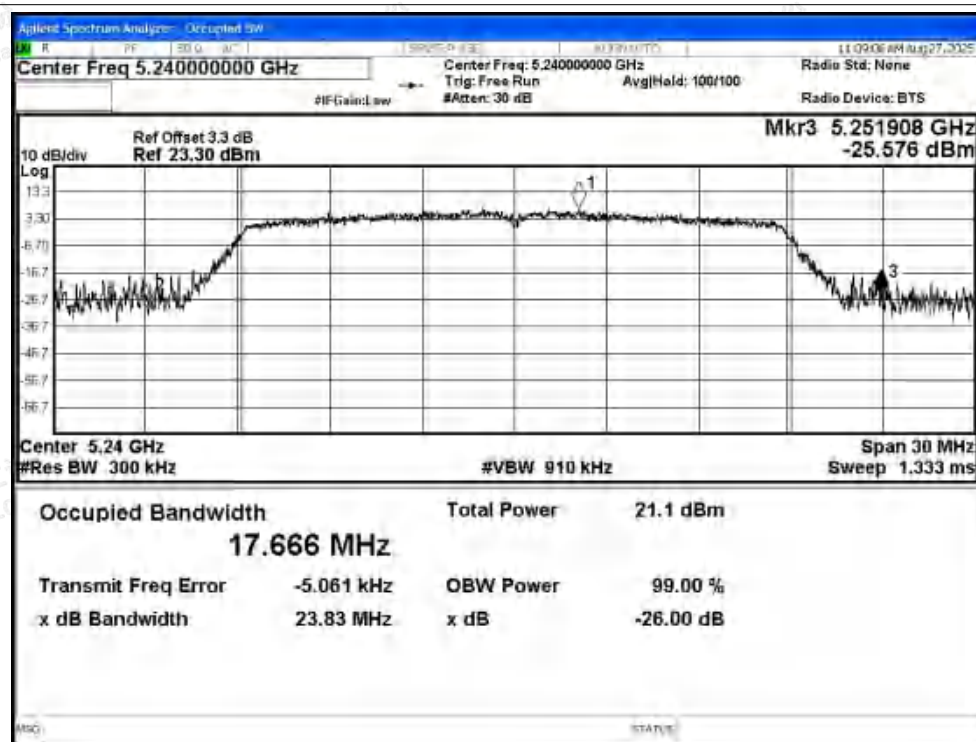


-26dB Bandwidth NVNT ac40 5190MHz Ant1

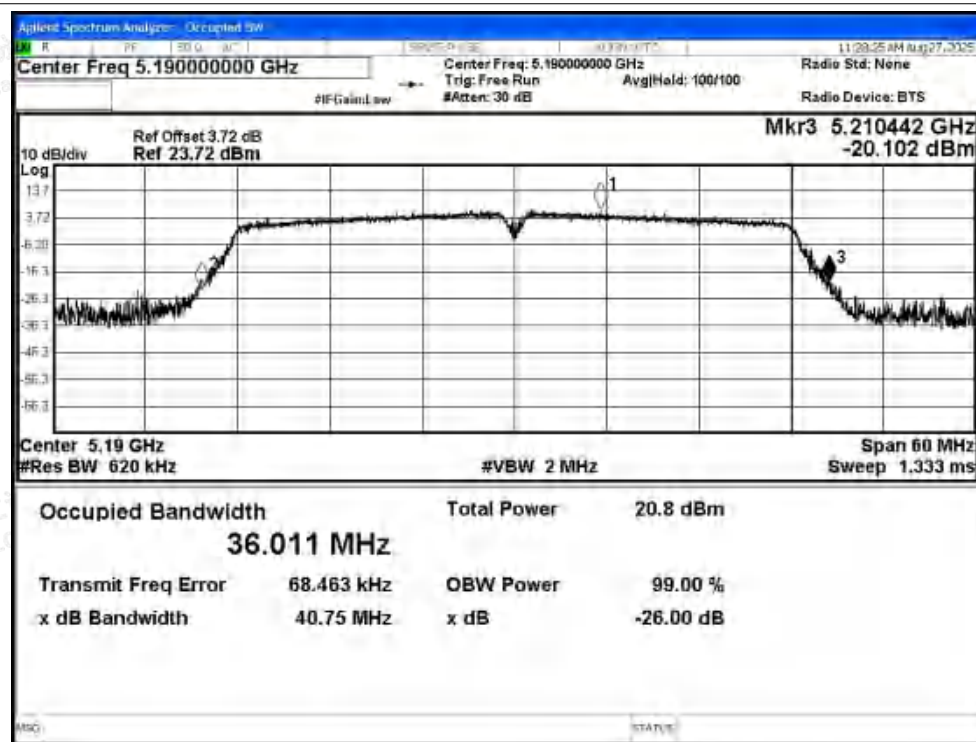




-26dB Bandwidth NVNT ac40 5230MHz Ant1

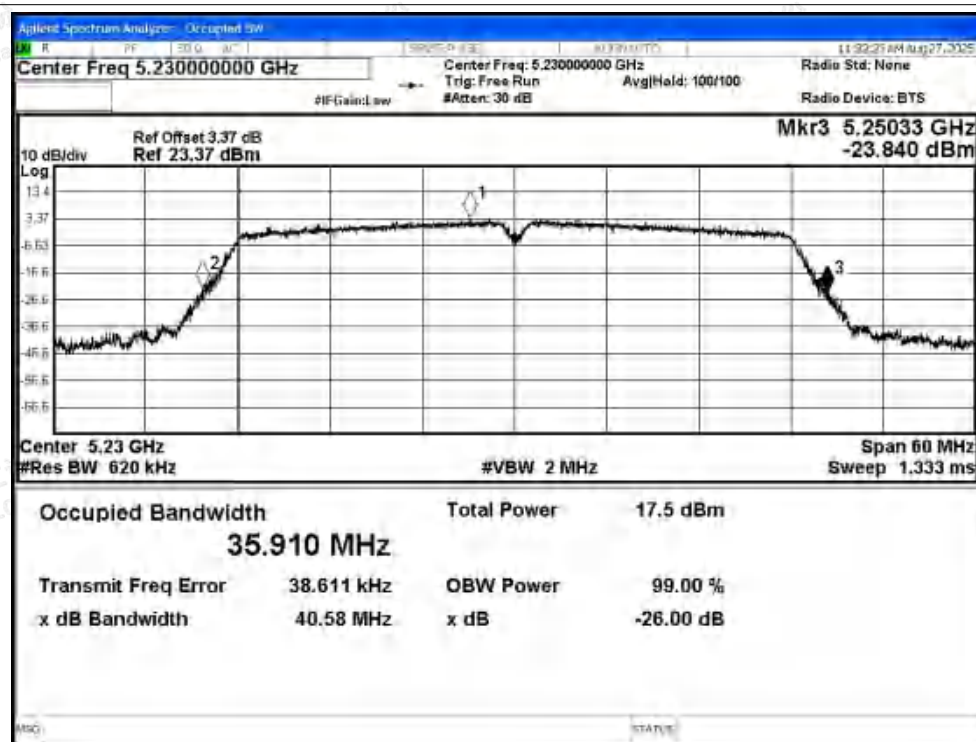

-26dB Bandwidth NVNT ac80 5210MHz Ant1

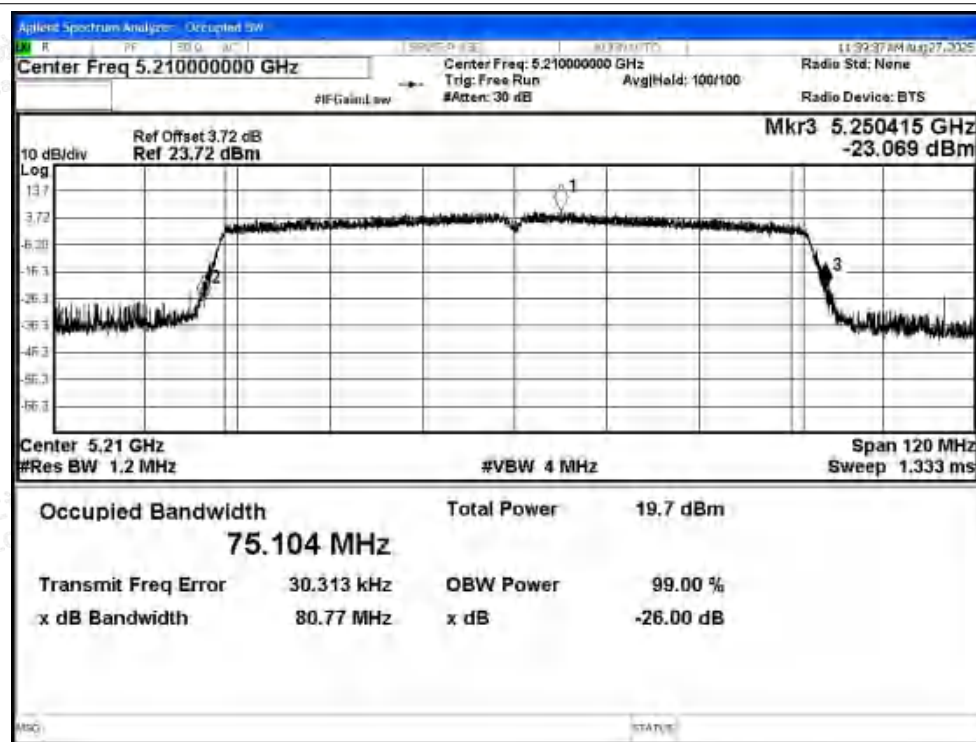

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-26dB Bandwidth NVNT ax20 5180MHz Ant1

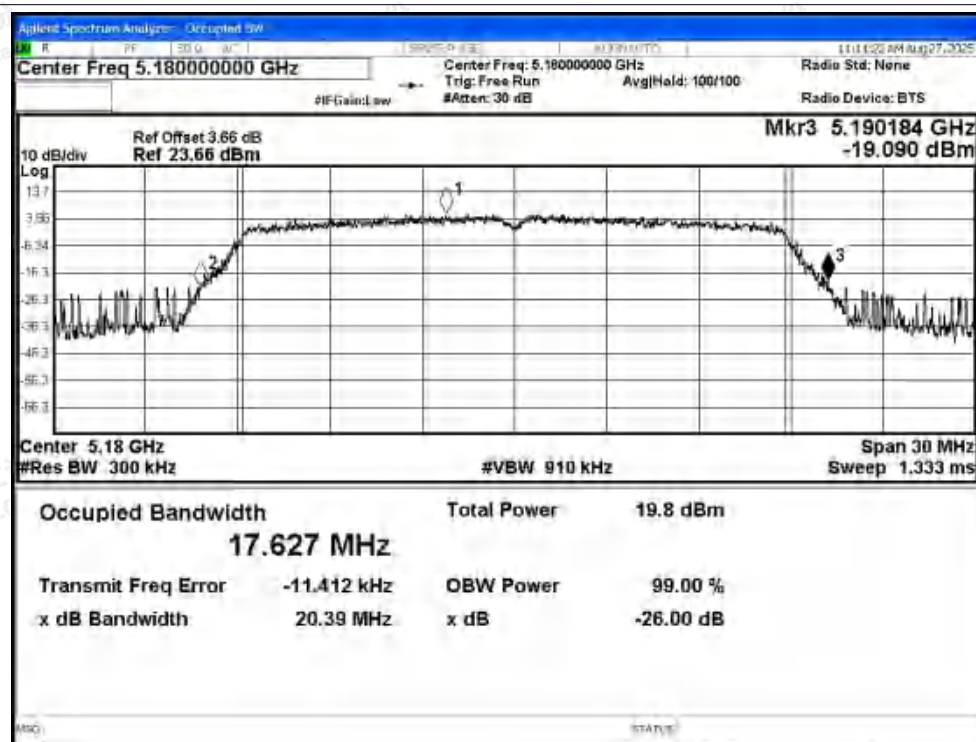

-26dB Bandwidth NVNT ax20 5200MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax20 5240MHz Ant1



-26dB Bandwidth NVNT ax40 5190MHz Ant1

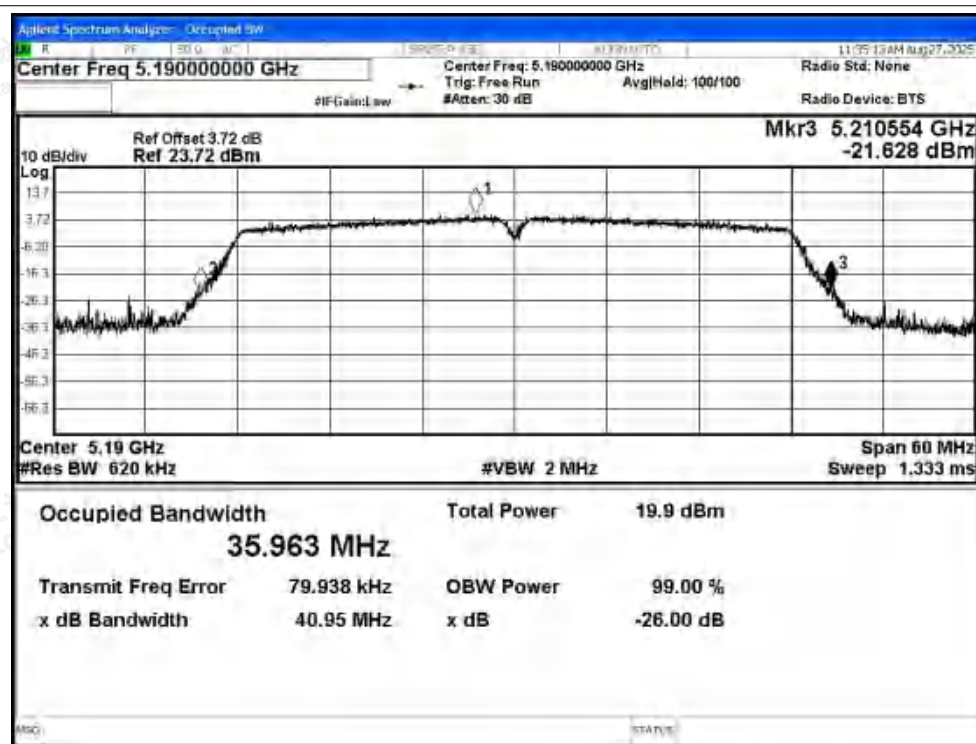

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax40 5230MHz Ant1

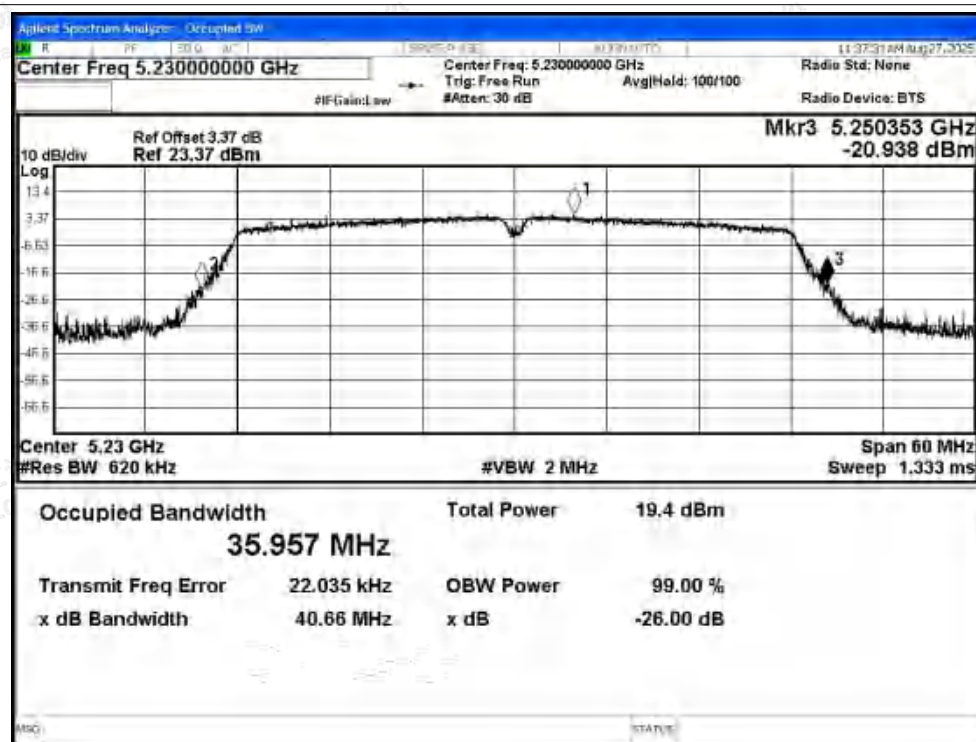


-26dB Bandwidth NVNT ax80 5210MHz Ant1

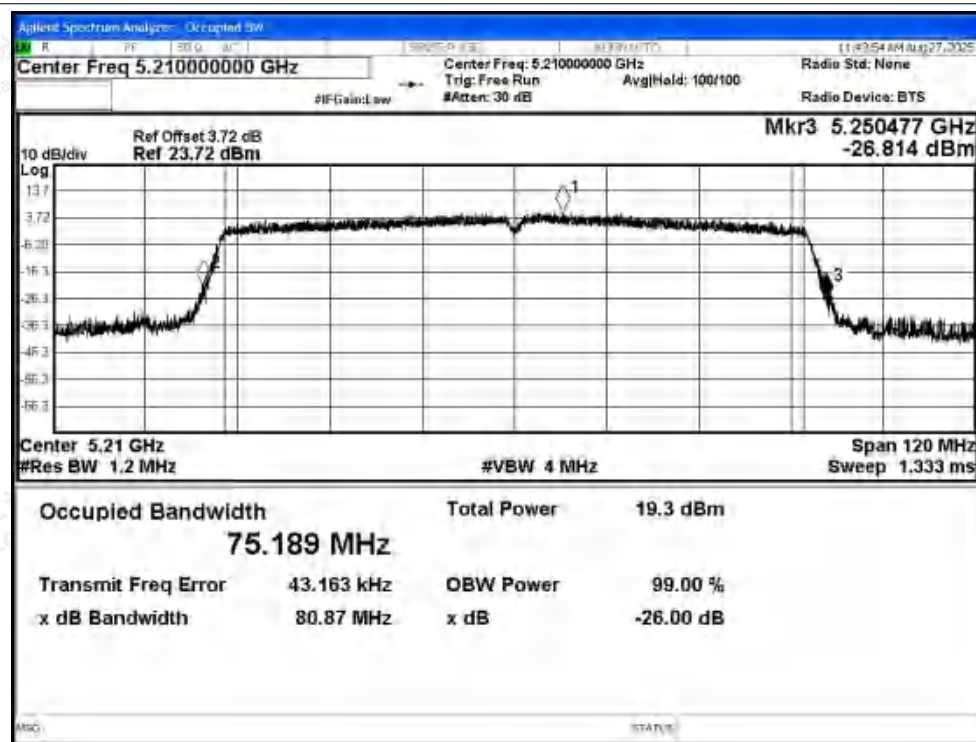




-26dB Bandwidth NVNT ac160 5250MHz Ant1

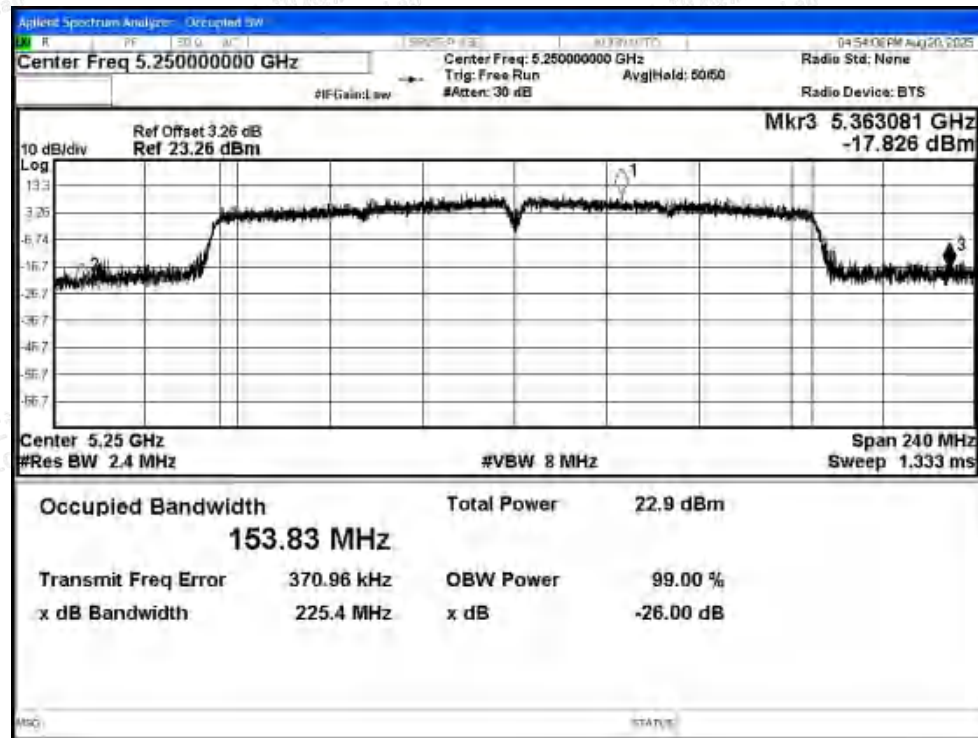

-26dB Bandwidth NVNT ax160 5250MHz Ant1

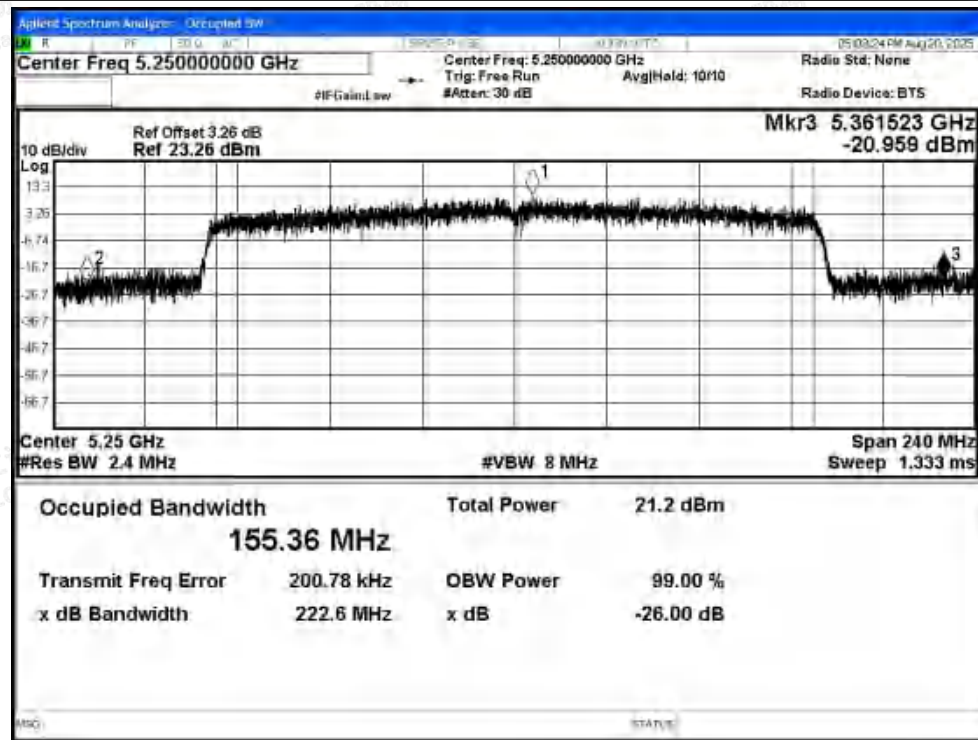


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Limit -26 dB Bandwidth (MHz)	Verdict
NVNT	a	5180	Ant2	20.091	≥ 0.5	Pass
NVNT	a	5200	Ant2	19.871	≥ 0.5	Pass
NVNT	a	5240	Ant2	19.96	≥ 0.5	Pass
NVNT	n20	5180	Ant2	19.961	≥ 0.5	Pass
NVNT	n20	5200	Ant2	19.936	≥ 0.5	Pass
NVNT	n20	5240	Ant2	19.722	≥ 0.5	Pass
NVNT	n40	5190	Ant2	40.503	≥ 0.5	Pass
NVNT	n40	5230	Ant2	40.343	≥ 0.5	Pass
NVNT	ac20	5180	Ant2	20.554	≥ 0.5	Pass
NVNT	ac20	5200	Ant2	20.458	≥ 0.5	Pass
NVNT	ac20	5240	Ant2	20.186	≥ 0.5	Pass
NVNT	ac40	5190	Ant2	40.273	≥ 0.5	Pass
NVNT	ac40	5230	Ant2	40.222	≥ 0.5	Pass
NVNT	ac80	5210	Ant2	80.714	≥ 0.5	Pass
NVNT	ax20	5180	Ant2	20.298	≥ 0.5	Pass
NVNT	ax20	5200	Ant2	20.221	≥ 0.5	Pass
NVNT	ax20	5240	Ant2	20.264	≥ 0.5	Pass
NVNT	ax40	5190	Ant2	40.759	≥ 0.5	Pass
NVNT	ax40	5230	Ant2	40.693	≥ 0.5	Pass
NVNT	ax80	5210	Ant2	80.984	≥ 0.5	Pass
NVNT	ac160	5250	Ant2	230.526	≥ 0.5	Pass
NVNT	ax160	5250	Ant2	212.621	≥ 0.5	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs

-26dB Bandwidth NVNT a 5180MHz Ant2

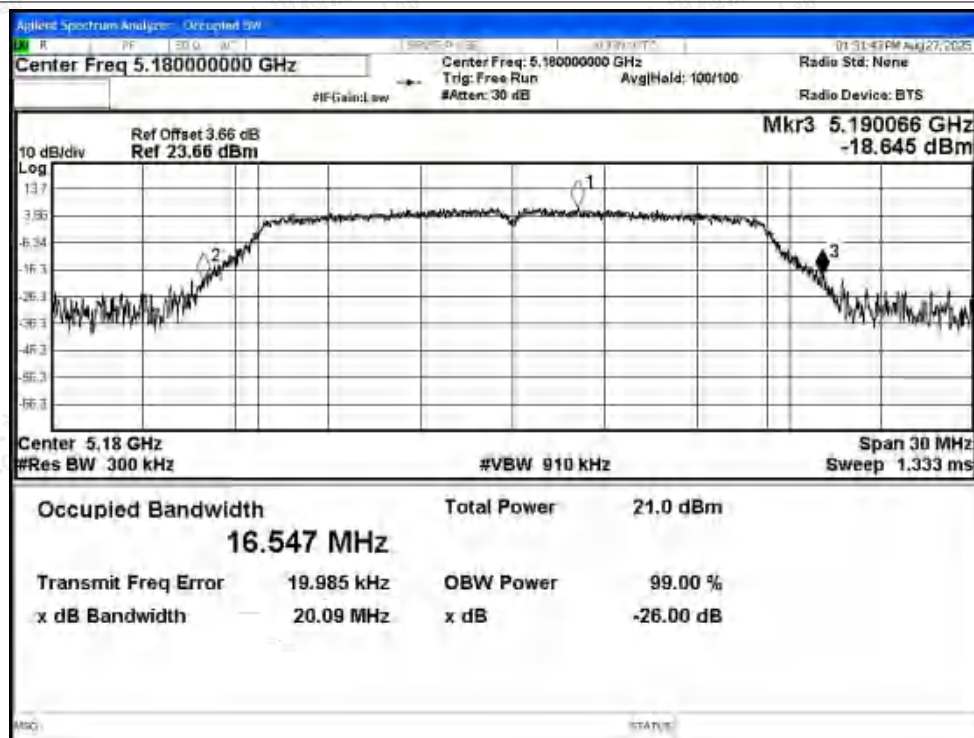

-26dB Bandwidth NVNT a 5200MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-26dB Bandwidth NVNT a 5240MHz Ant2

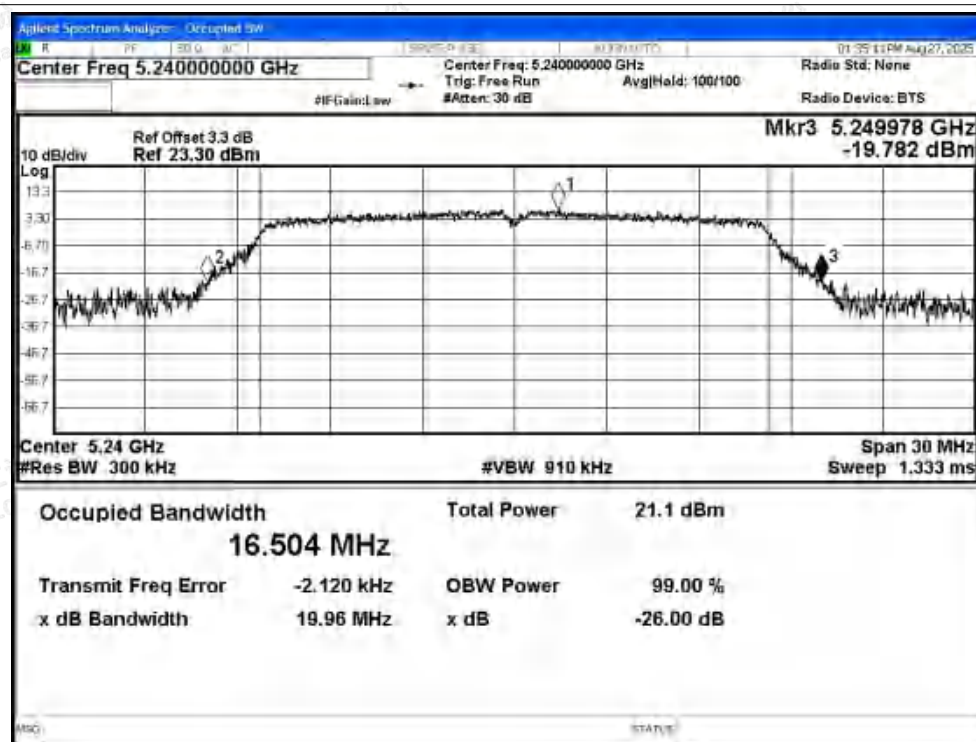


-26dB Bandwidth NVNT n20 5180MHz Ant2






-26dB Bandwidth NVNT n20 5200MHz Ant2

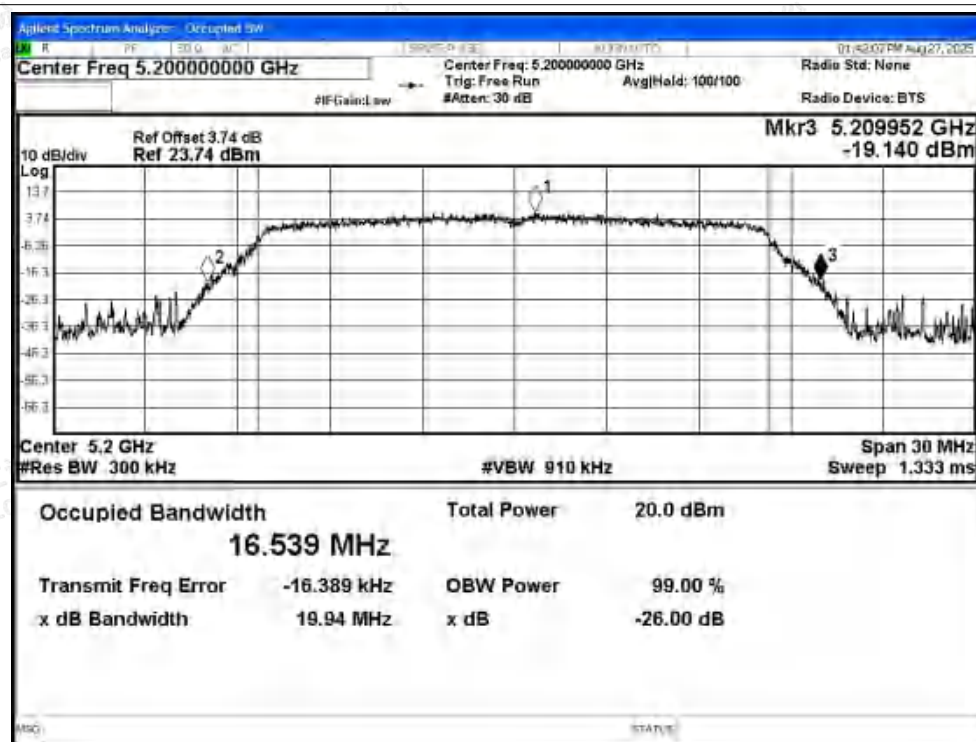


-26dB Bandwidth NVNT n20 5240MHz Ant2

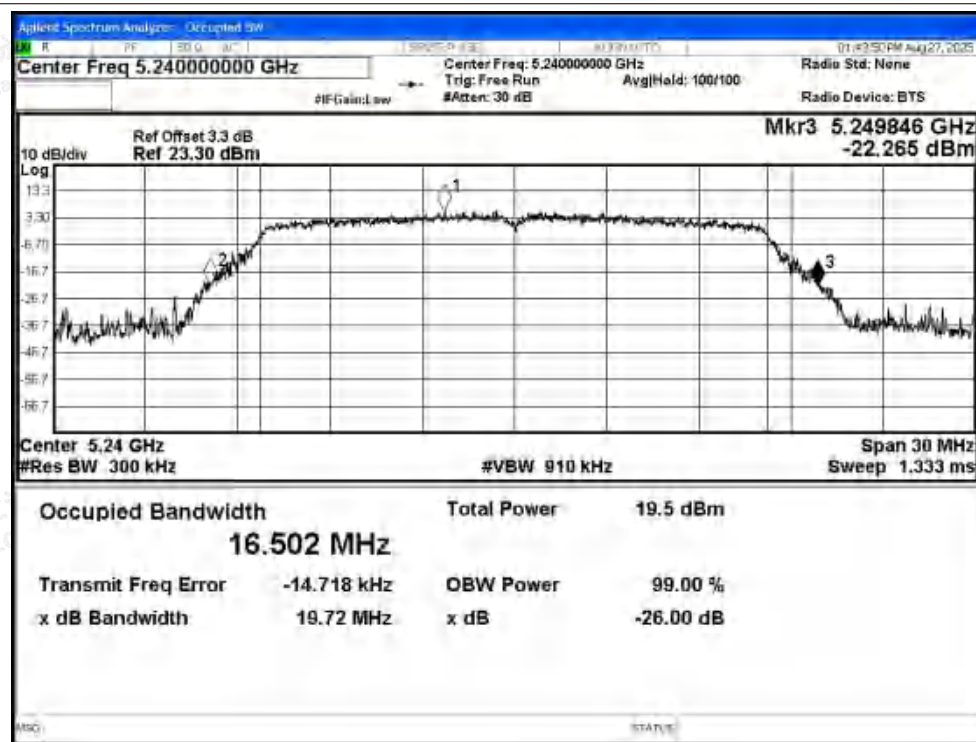




-26dB Bandwidth NVNT n40 5190MHz Ant2

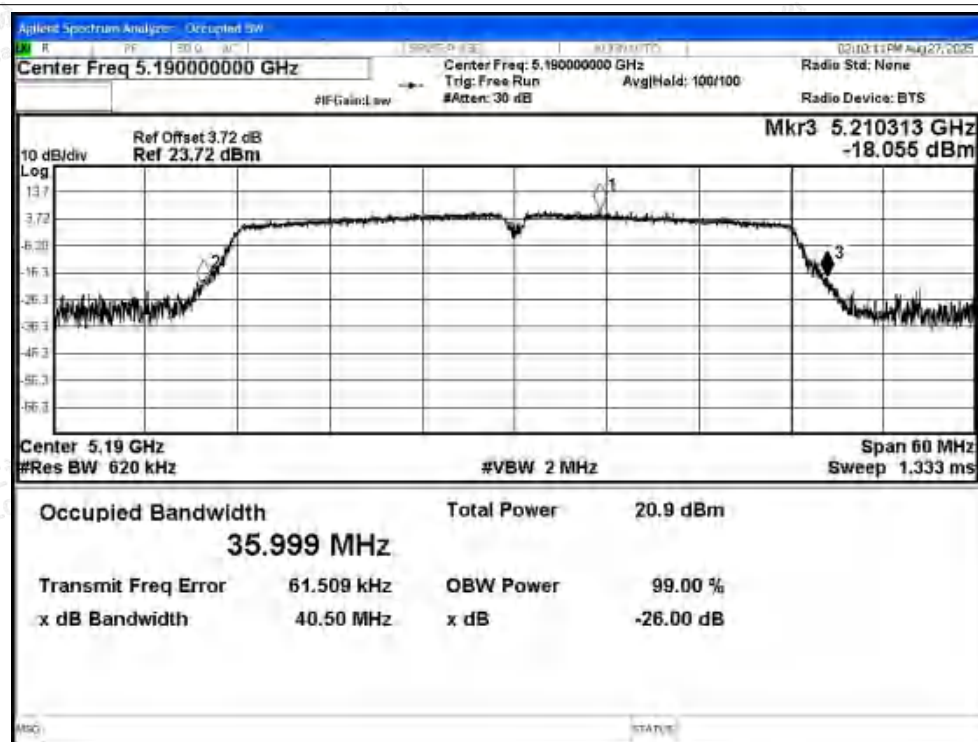

-26dB Bandwidth NVNT n40 5230MHz Ant2

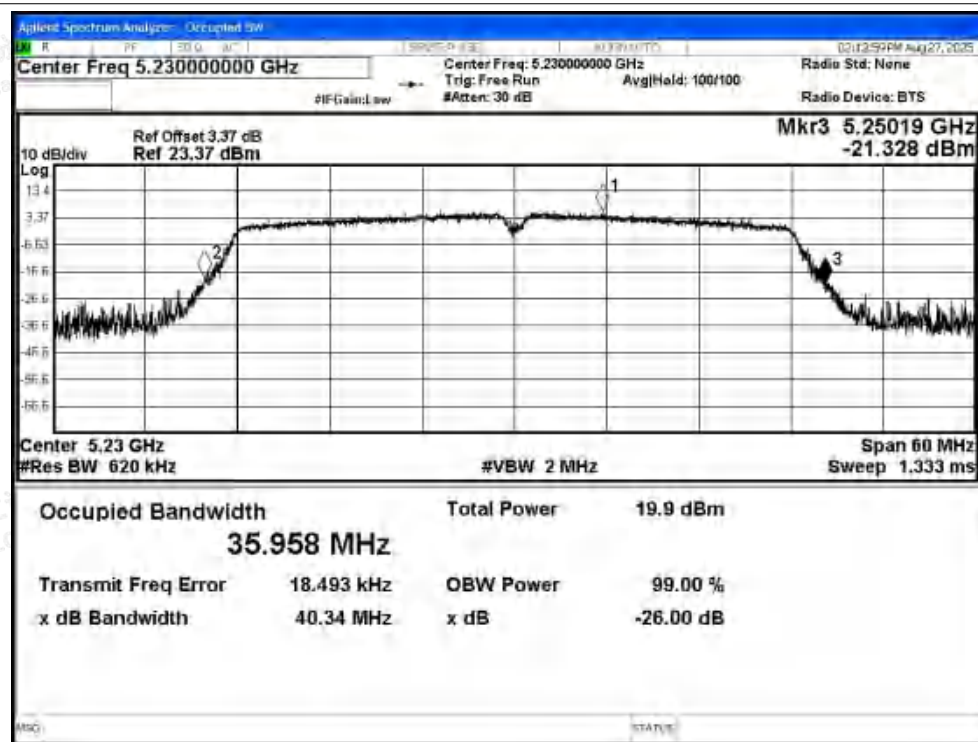


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac20 5180MHz Ant2

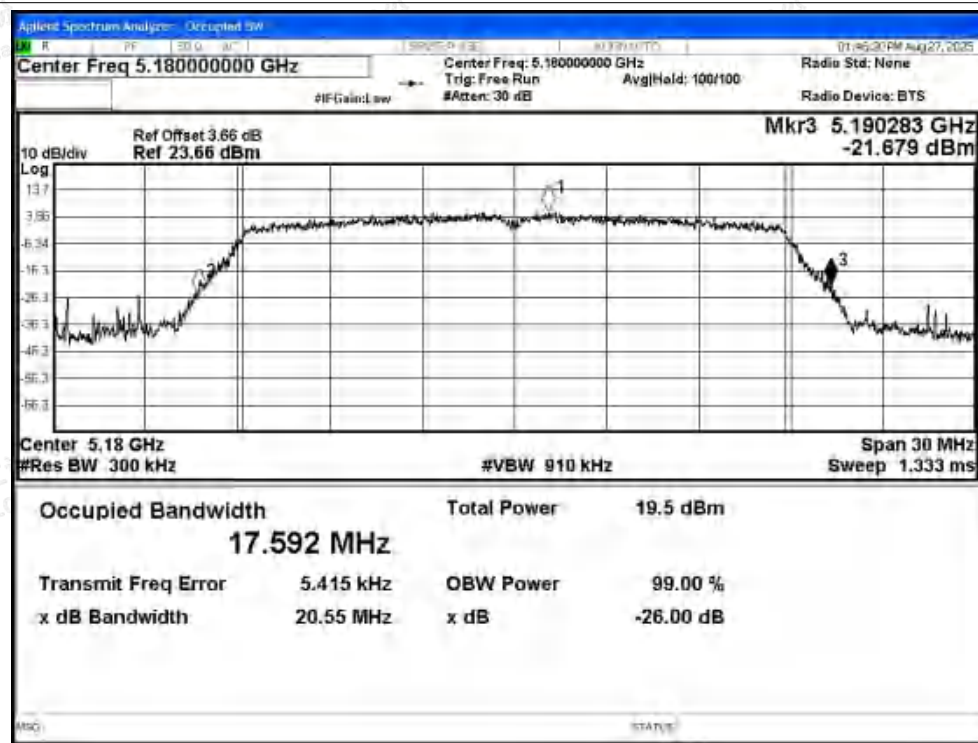

-26dB Bandwidth NVNT ac20 5200MHz Ant2

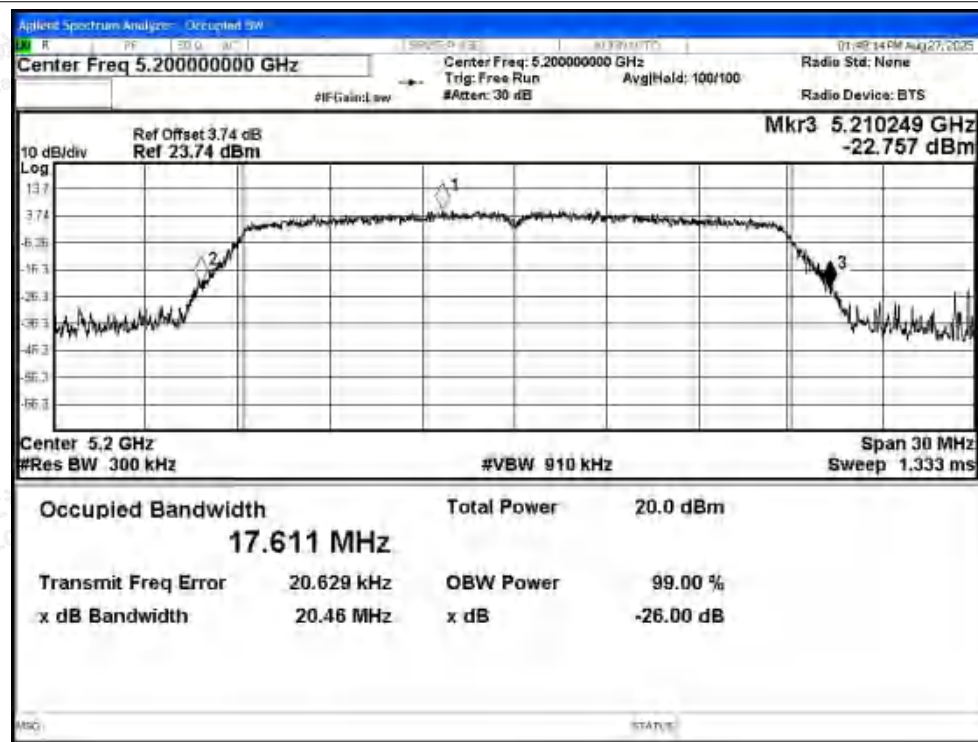

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-26dB Bandwidth NVNT ac20 5240MHz Ant2

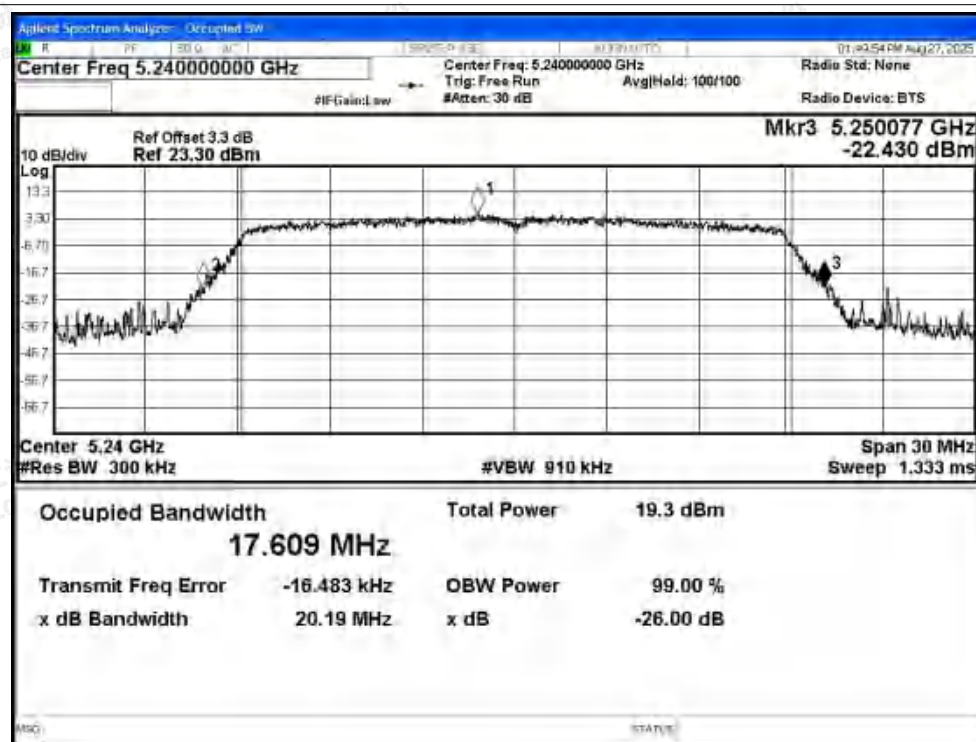

-26dB Bandwidth NVNT ac40 5190MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac40 5230MHz Ant2

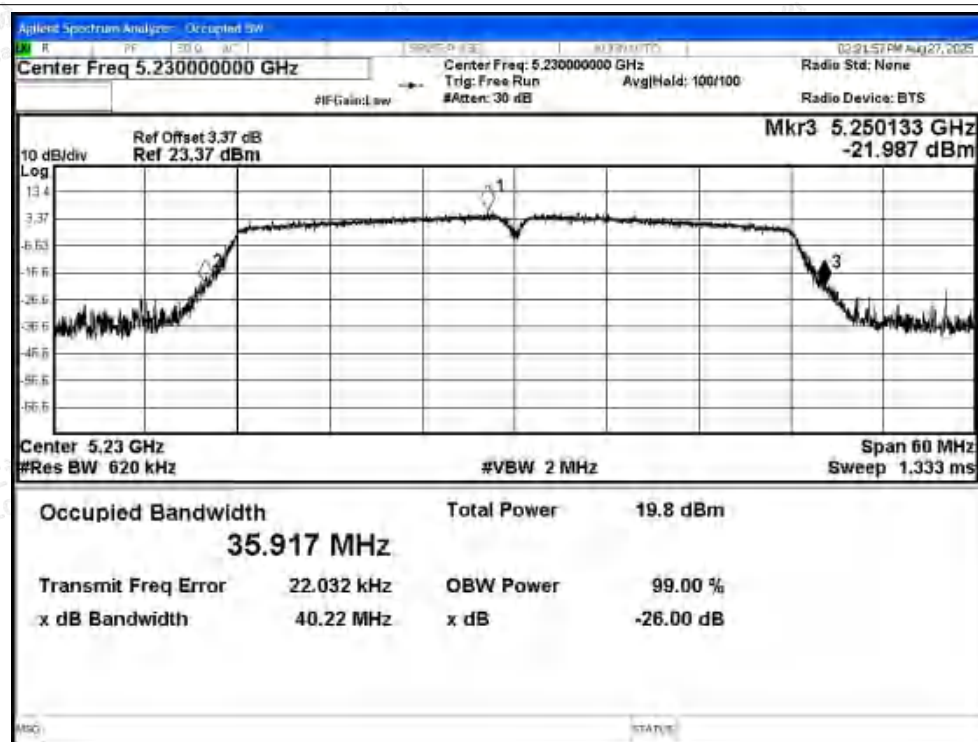

-26dB Bandwidth NVNT ac80 5210MHz Ant2

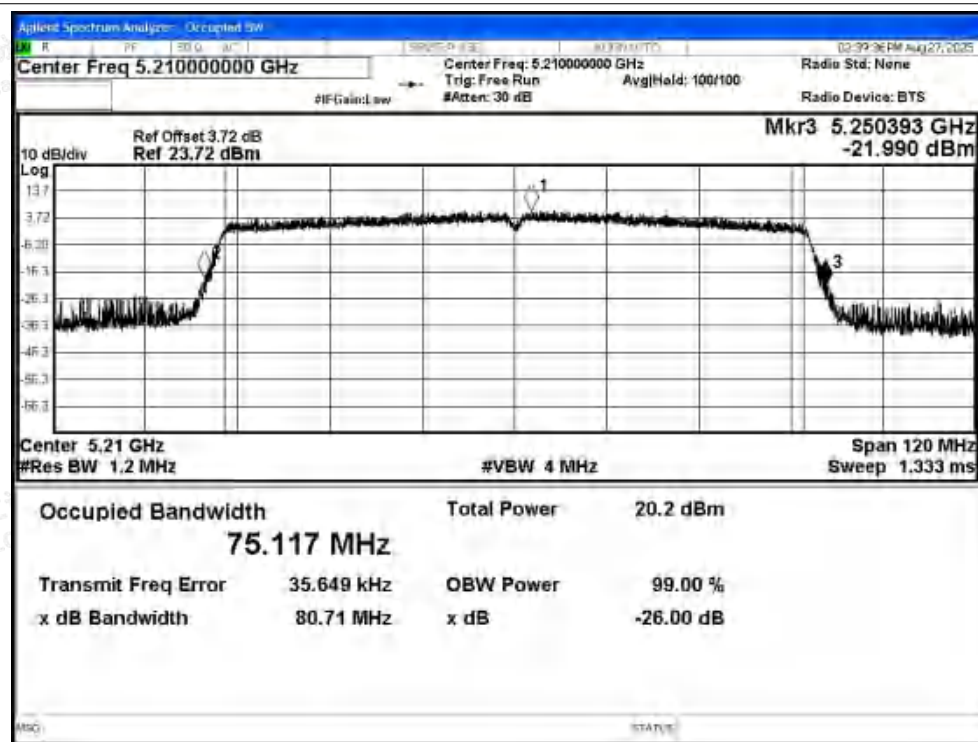

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-26dB Bandwidth NVNT ax20 5180MHz Ant2



-26dB Bandwidth NVNT ax20 5200MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-26dB Bandwidth NVNT ax20 5240MHz Ant2

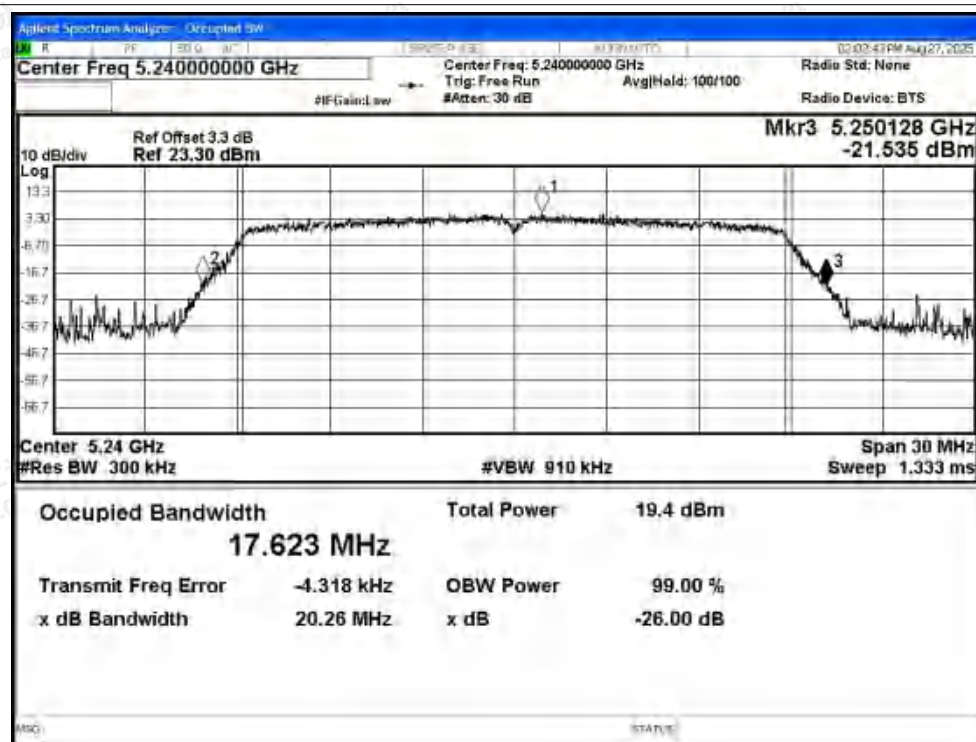

-26dB Bandwidth NVNT ax40 5190MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ax40 5230MHz Ant2

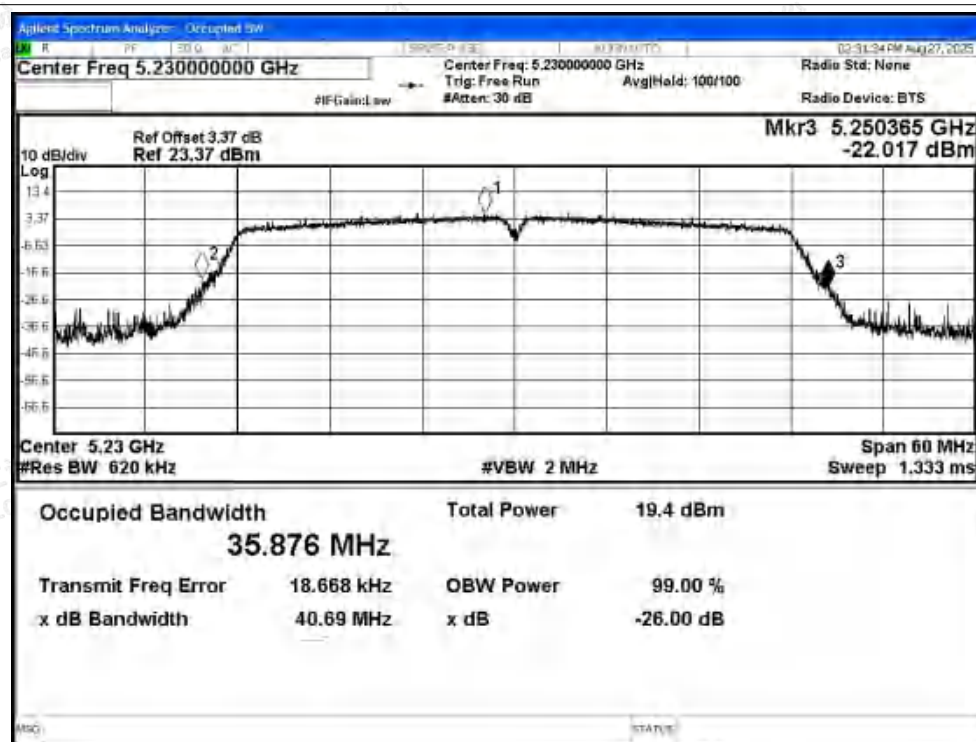

-26dB Bandwidth NVNT ax80 5210MHz Ant2

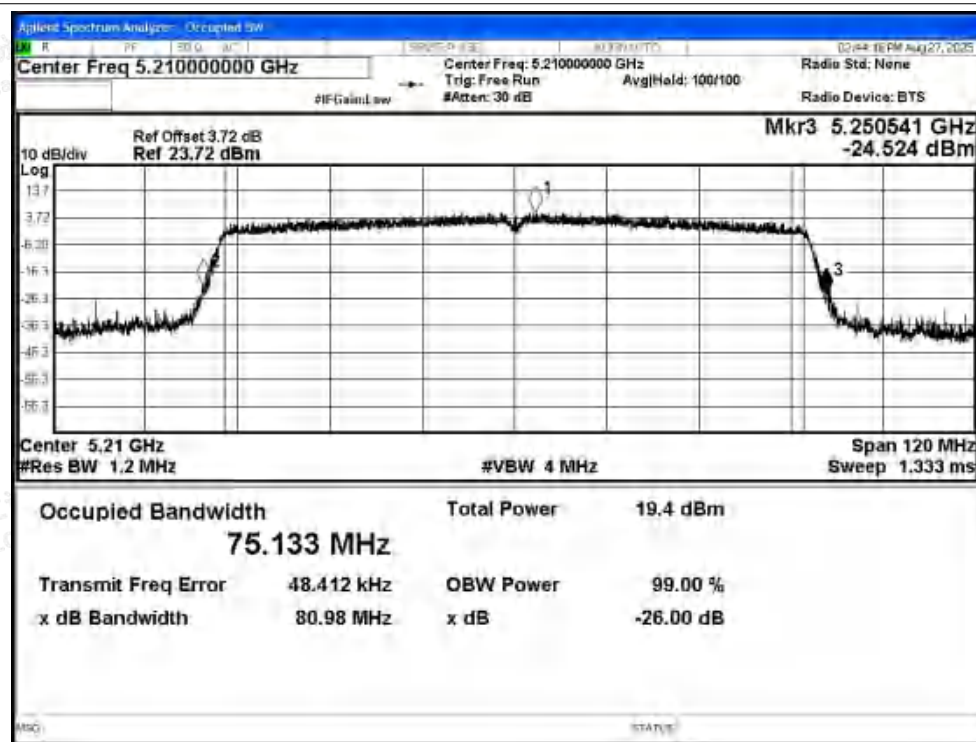

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-26dB Bandwidth NVNT ac160 5250MHz Ant2

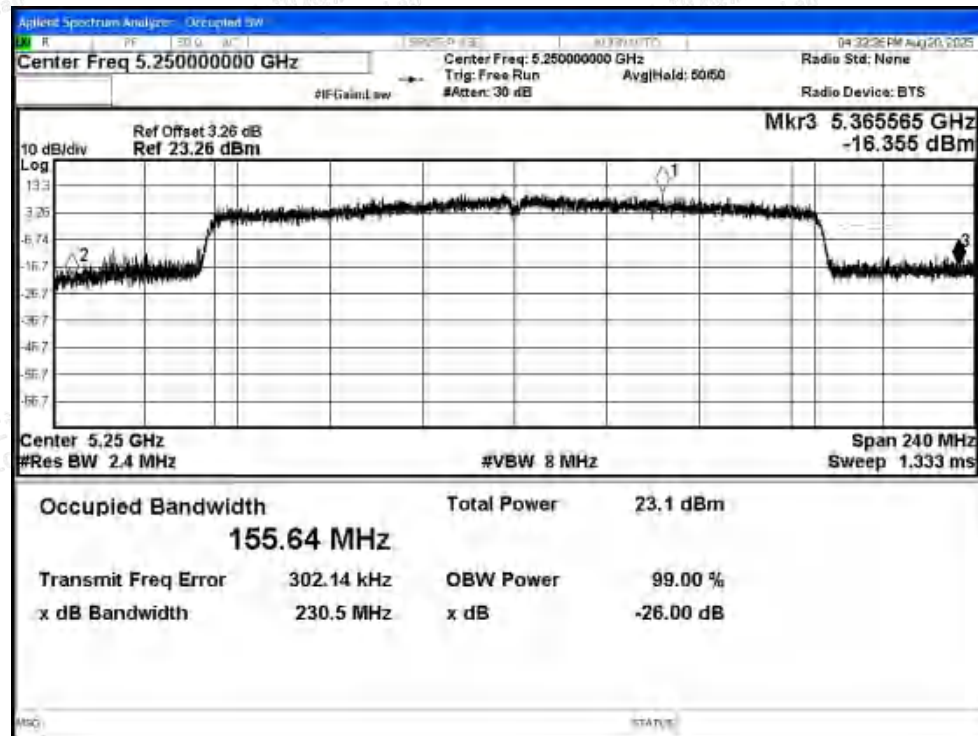

-26dB Bandwidth NVNT ax160 5250MHz Ant2

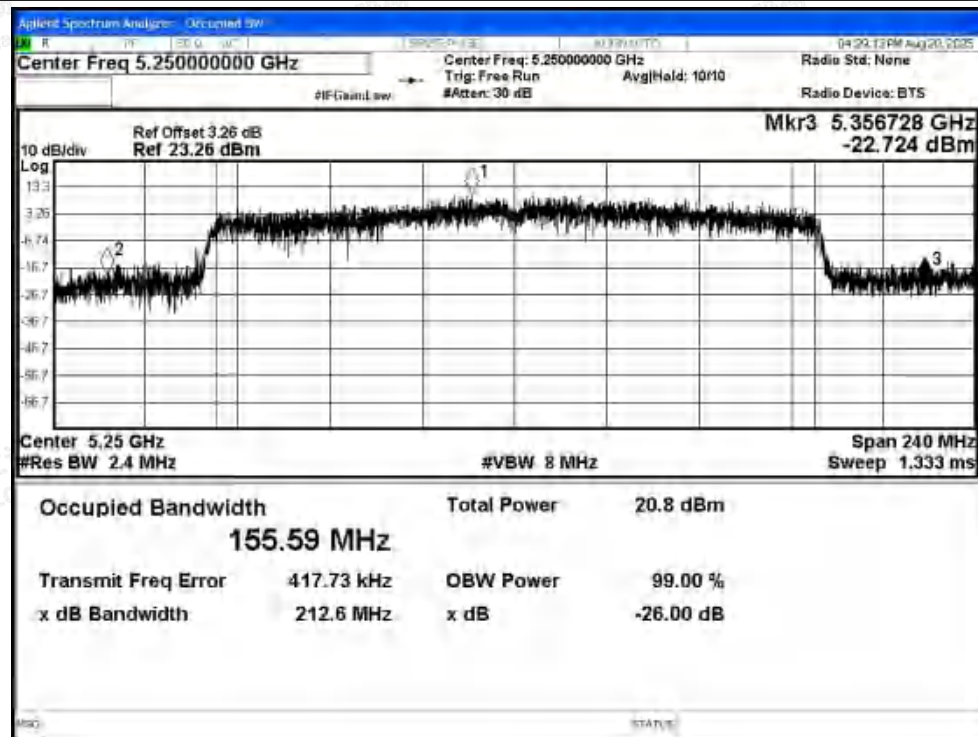


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



B.2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	15.3	0.11	15.41	30	Pass
NVNT	a	5200	Ant1	15.91	0.11	16.02	30	Pass
NVNT	a	5240	Ant1	15.51	0.11	15.62	30	Pass
NVNT	n20	5180	Ant1	15.43	0.11	15.54	30	Pass
NVNT	n20	5200	Ant1	16.06	0.11	16.17	30	Pass
NVNT	n20	5240	Ant1	14.98	0.11	15.09	30	Pass
NVNT	n40	5190	Ant1	13.77	0.23	14.00	30	Pass
NVNT	n40	5230	Ant1	13.14	0.22	13.36	30	Pass
NVNT	ac20	5180	Ant1	15.73	0.12	15.85	30	Pass
NVNT	ac20	5200	Ant1	15.97	0.12	16.09	30	Pass
NVNT	ac20	5240	Ant1	15.32	0.12	15.44	30	Pass
NVNT	ac40	5190	Ant1	14.62	0.23	14.85	30	Pass
NVNT	ac40	5230	Ant1	11.2	0.23	11.43	30	Pass
NVNT	ac80	5210	Ant1	12.63	0.43	13.06	30	Pass
NVNT	ax20	5180	Ant1	14.18	0.12	14.30	30	Pass
NVNT	ax20	5200	Ant1	14.33	0.12	14.45	30	Pass
NVNT	ax20	5240	Ant1	13.75	0.12	13.87	30	Pass
NVNT	ax40	5190	Ant1	13.67	0.23	13.90	30	Pass
NVNT	ax40	5230	Ant1	13.2	0.23	13.43	30	Pass
NVNT	ax80	5210	Ant1	12.04	0.43	12.47	30	Pass
NVNT	ac160	5250	Ant1	14.21	2.76	16.97	30	Pass
NVNT	ax160	5250	Ant1	15.56	2.81	18.37	30	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant2	15.37	0.11	15.48	30	Pass
NVNT	a	5200	Ant2	15.52	0.11	15.63	30	Pass
NVNT	a	5240	Ant2	15.29	0.11	15.40	30	Pass
NVNT	n20	5180	Ant2	13.85	0.11	13.96	30	Pass
NVNT	n20	5200	Ant2	14.41	0.11	14.52	30	Pass
NVNT	n20	5240	Ant2	13.79	0.11	13.90	30	Pass
NVNT	n40	5190	Ant2	14.78	0.22	15.00	30	Pass
NVNT	n40	5230	Ant2	13.5	0.23	13.73	30	Pass
NVNT	ac20	5180	Ant2	13.82	0.11	13.93	30	Pass
NVNT	ac20	5200	Ant2	14.38	0.12	14.50	30	Pass
NVNT	ac20	5240	Ant2	13.65	0.11	13.76	30	Pass
NVNT	ac40	5190	Ant2	13.81	0.22	14.03	30	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5230	Ant2	13.59	0.23	13.82	30	Pass
NVNT	ac80	5210	Ant2	13.2	0.43	13.63	30	Pass
NVNT	ax20	5180	Ant2	14.28	0.11	14.39	30	Pass
NVNT	ax20	5200	Ant2	13.83	0.11	13.94	30	Pass
NVNT	ax20	5240	Ant2	13.75	0.12	13.87	30	Pass
NVNT	ax40	5190	Ant2	13.76	0.22	13.98	30	Pass
NVNT	ax40	5230	Ant2	13.05	0.22	13.27	30	Pass
NVNT	ax80	5210	Ant2	11.96	0.43	12.39	30	Pass
NVNT	ac160	5250	Ant2	11.56	2.81	14.37	30	Pass
NVNT	ax160	5250	Ant2	14.21	2.81	17.02	30	Pass

MIMO

Condition	Mode	Frequency (MHz)	Total Power (dBm)			Limit (dBm)	Verdict
			Ant1	Ant2	Ant1+Ant2		
NVNT	n20	5180	15.54	13.96	17.83	30	Pass
NVNT	n20	5200	16.17	14.52	18.43	30	Pass
NVNT	n20	5240	15.09	13.90	17.55	30	Pass
NVNT	n40	5190	14.00	15.00	17.54	30	Pass
NVNT	n40	5230	13.36	13.73	16.56	30	Pass
NVNT	ac20	5180	15.85	13.93	18.01	30	Pass
NVNT	ac20	5200	16.09	14.50	18.38	30	Pass
NVNT	ac20	5240	15.44	13.76	17.69	30	Pass
NVNT	ac40	5190	14.85	14.03	17.47	30	Pass
NVNT	ac40	5230	11.43	13.82	15.80	30	Pass
NVNT	ac80	5210	13.06	13.63	16.36	30	Pass
NVNT	ax20	5180	14.30	14.39	17.36	30	Pass
NVNT	ax20	5200	14.45	13.94	17.21	30	Pass
NVNT	ax20	5240	13.87	13.87	16.88	30	Pass
NVNT	ax40	5190	13.90	13.98	16.95	30	Pass
NVNT	ax40	5230	13.43	13.27	16.36	30	Pass
NVNT	ax80	5210	12.47	12.39	15.44	30	Pass
NVNT	ac160	5250	16.97	14.37	18.87	30	Pass
NVNT	ax160	5250	18.37	17.02	20.76	30	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



B.3 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5180	Ant1	5.71	0.11	5.82	17	Pass
NVNT	a	5200	Ant1	6.24	0.11	6.35	17	Pass
NVNT	a	5240	Ant1	5.85	0.11	5.96	17	Pass
NVNT	n20	5180	Ant1	6.2	0.11	6.31	17	Pass
NVNT	n20	5200	Ant1	6.29	0.11	6.40	17	Pass
NVNT	n20	5240	Ant1	5.34	0.11	5.45	17	Pass
NVNT	n40	5190	Ant1	0.97	0.23	1.20	17	Pass
NVNT	n40	5230	Ant1	0.99	0.22	1.21	17	Pass
NVNT	ac20	5180	Ant1	5.83	0.12	5.95	17	Pass
NVNT	ac20	5200	Ant1	6.07	0.12	6.19	17	Pass
NVNT	ac20	5240	Ant1	5.59	0.12	5.71	17	Pass
NVNT	ac40	5190	Ant1	1.97	0.23	2.20	17	Pass
NVNT	ac40	5230	Ant1	-1.28	0.23	-1.05	17	Pass
NVNT	ac80	5210	Ant1	-3.05	0.43	-2.62	17	Pass
NVNT	ax20	5180	Ant1	4.25	0.12	4.37	17	Pass
NVNT	ax20	5200	Ant1	4.35	0.12	4.47	17	Pass
NVNT	ax20	5240	Ant1	4.26	0.12	4.38	17	Pass
NVNT	ax40	5190	Ant1	1.03	0.23	1.26	17	Pass
NVNT	ax40	5230	Ant1	0.61	0.23	0.84	17	Pass
NVNT	ax80	5210	Ant1	-3.13	0.43	-2.70	17	Pass
NVNT	ac160	5250	Ant1	-4.42	2.76	-1.66	17	Pass
NVNT	ax160	5250	Ant1	-4.84	2.81	-2.03	17	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5180	Ant2	5.69	0.11	5.80	17	Pass
NVNT	a	5200	Ant2	5.9	0.11	6.01	17	Pass
NVNT	a	5240	Ant2	5.69	0.11	5.80	17	Pass
NVNT	n20	5180	Ant2	4.56	0.11	4.67	17	Pass
NVNT	n20	5200	Ant2	5.1	0.11	5.21	17	Pass
NVNT	n20	5240	Ant2	4.2	0.11	4.31	17	Pass
NVNT	n40	5190	Ant2	1.95	0.22	2.17	17	Pass
NVNT	n40	5230	Ant2	1.22	0.23	1.45	17	Pass
NVNT	ac20	5180	Ant2	4.13	0.11	4.24	17	Pass
NVNT	ac20	5200	Ant2	4.55	0.12	4.67	17	Pass
NVNT	ac20	5240	Ant2	4.1	0.11	4.21	17	Pass
NVNT	ac40	5190	Ant2	1.18	0.22	1.40	17	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5230	Ant2	1.17	0.23	1.40	17	Pass
NVNT	ac80	5210	Ant2	-2.57	0.43	-2.14	17	Pass
NVNT	ax20	5180	Ant2	4.45	0.11	4.56	17	Pass
NVNT	ax20	5200	Ant2	4.13	0.11	4.24	17	Pass
NVNT	ax20	5240	Ant2	4.03	0.12	4.15	17	Pass
NVNT	ax40	5190	Ant2	0.74	0.22	0.96	17	Pass
NVNT	ax40	5230	Ant2	0.74	0.22	0.96	17	Pass
NVNT	ax80	5210	Ant2	-3.2	0.43	-2.77	17	Pass
NVNT	ac160	5250	Ant2	-3.47	2.81	-0.66	17	Pass
NVNT	ax160	5250	Ant2	-4.37	2.81	-1.56	17	Pass

MIMO

Condition	Mode	Frequency (MHz)	Total PSD (dBm/MHz)			Limit (dBm/MHz)	Verdict
			Ant1	Ant2	Ant1+Ant2		
NVNT	n20	5180	6.31	4.67	8.58	15.05	Pass
NVNT	n20	5200	6.40	5.21	8.86	15.05	Pass
NVNT	n20	5240	5.45	4.31	7.93	15.05	Pass
NVNT	n40	5190	1.20	2.17	4.72	15.05	Pass
NVNT	n40	5230	1.21	1.45	4.34	15.05	Pass
NVNT	ac20	5180	5.95	4.24	8.19	15.05	Pass
NVNT	ac20	5200	6.19	4.67	8.51	15.05	Pass
NVNT	ac20	5240	5.71	4.21	8.03	15.05	Pass
NVNT	ac40	5190	2.20	1.40	4.83	15.05	Pass
NVNT	ac40	5230	-1.05	1.40	3.36	15.05	Pass
NVNT	ac80	5210	-2.62	-2.14	0.64	15.05	Pass
NVNT	ax20	5180	4.37	4.56	7.48	15.05	Pass
NVNT	ax20	5200	4.47	4.24	7.37	15.05	Pass
NVNT	ax20	5240	4.38	4.15	7.28	15.05	Pass
NVNT	ax40	5190	1.26	0.96	4.12	15.05	Pass
NVNT	ax40	5230	0.84	0.96	3.91	15.05	Pass
NVNT	ax80	5210	-2.70	-2.77	0.28	15.05	Pass
NVNT	ac160	5250	-1.66	-0.66	1.88	15.05	Pass
NVNT	ax160	5250	-2.03	-1.56	1.22	15.05	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

PSD NVNT a 5180MHz Ant1

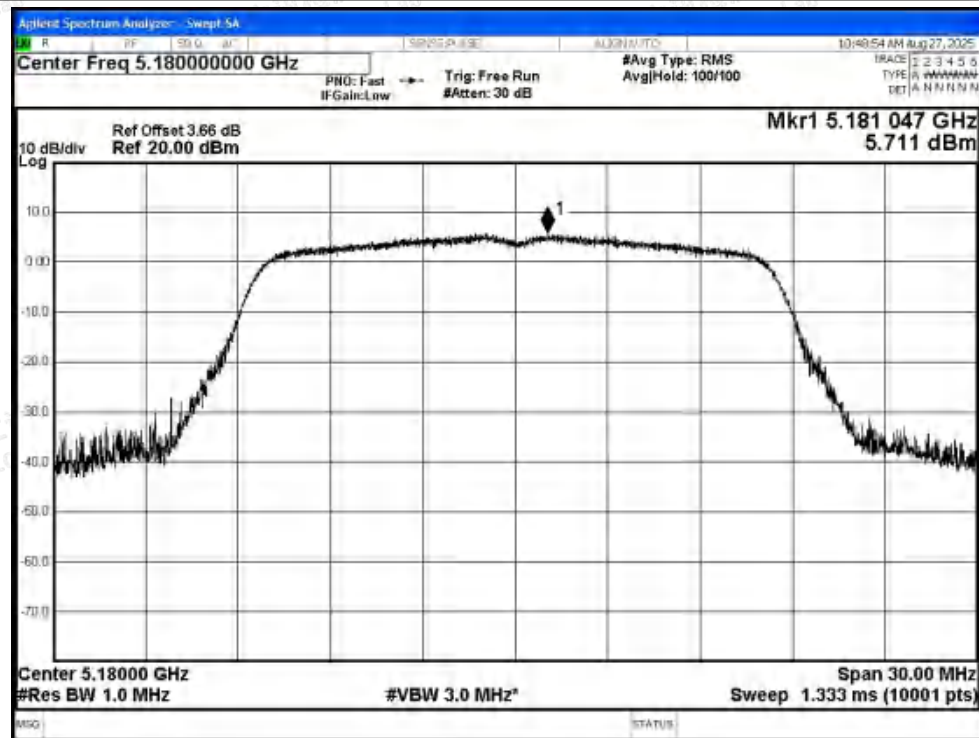

PSD NVNT a 5200MHz Ant1

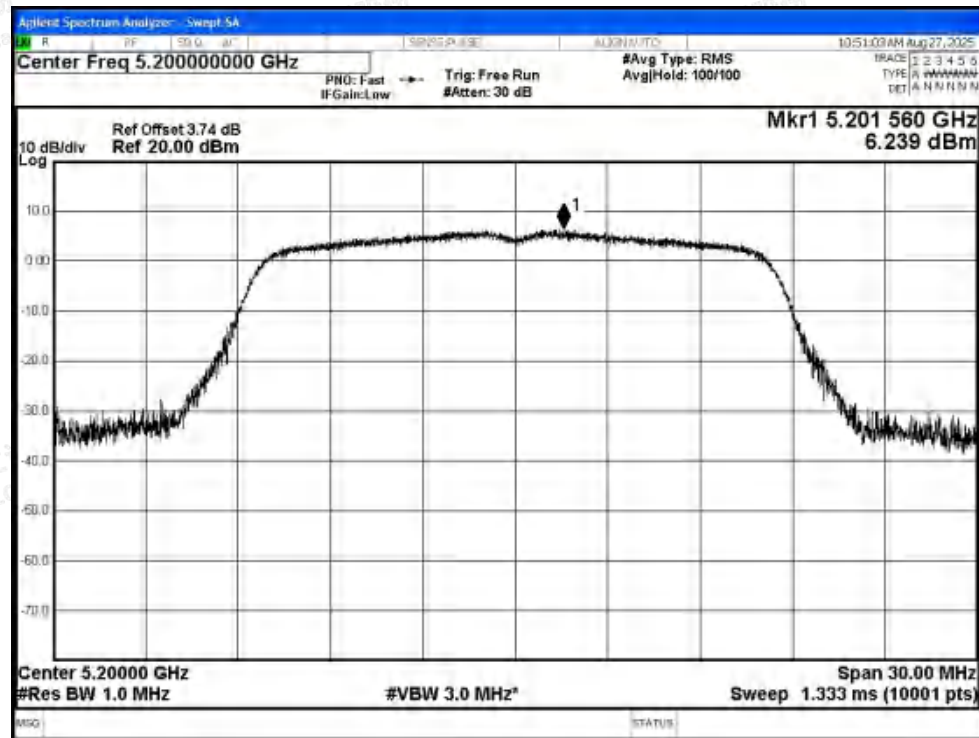

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT a 5240MHz Ant1

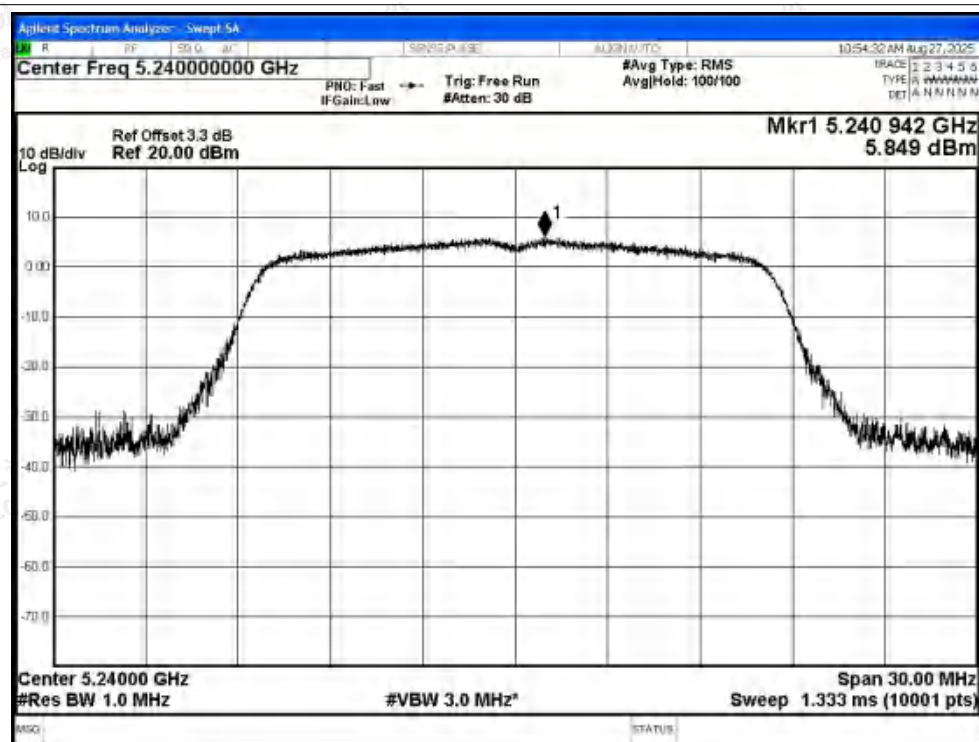

PSD NVNT n20 5180MHz Ant1

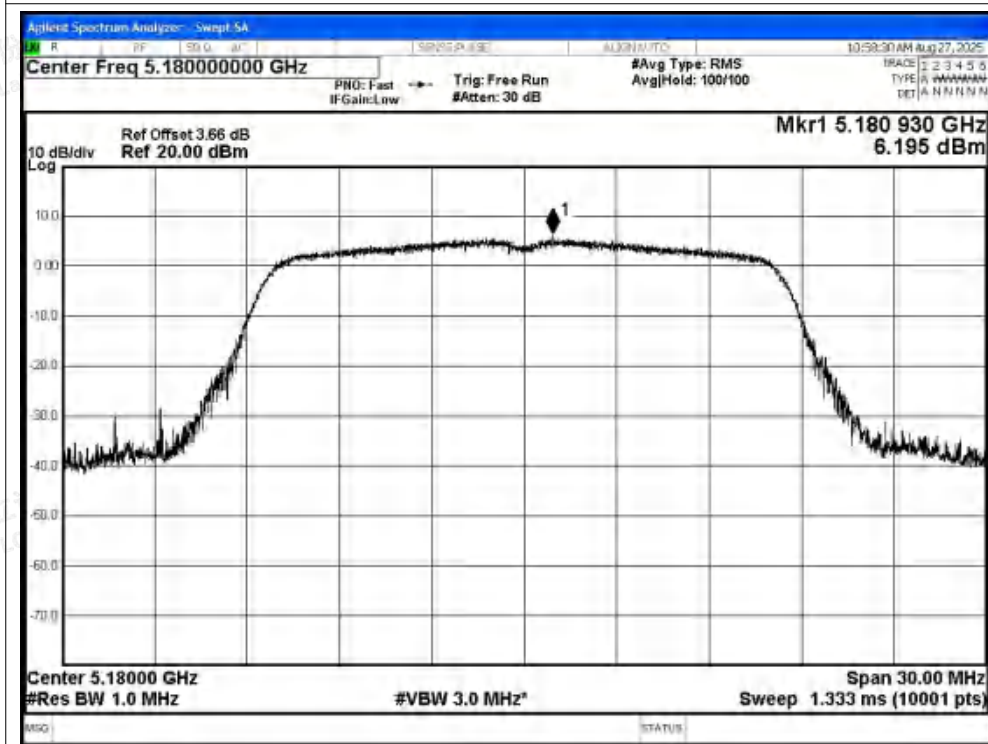

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT n20 5200MHz Ant1

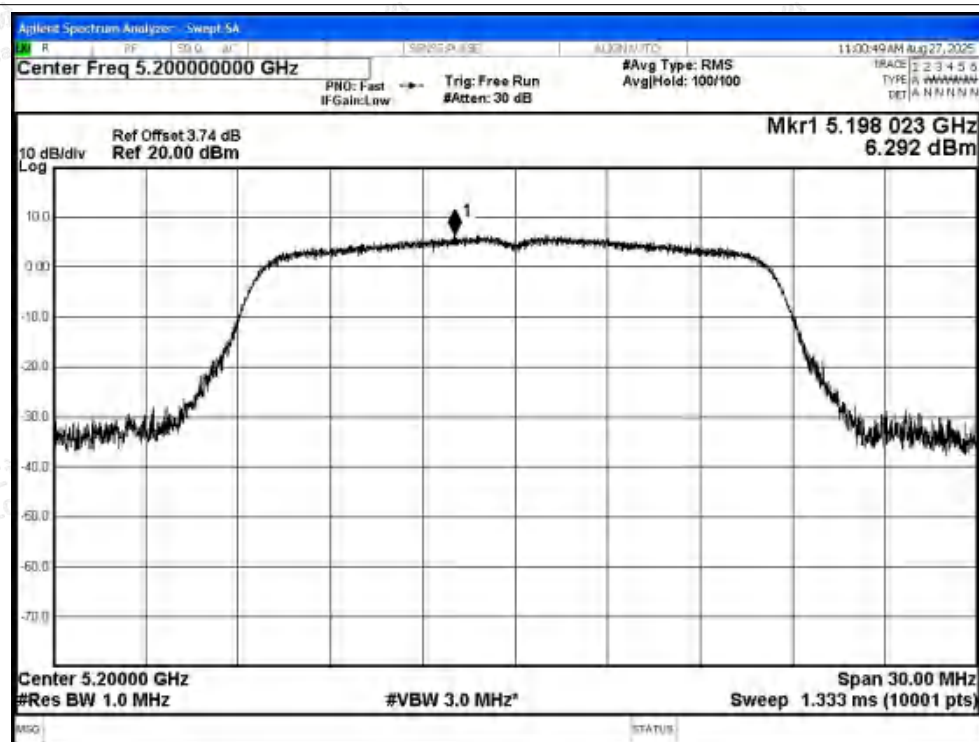

PSD NVNT n20 5240MHz Ant1

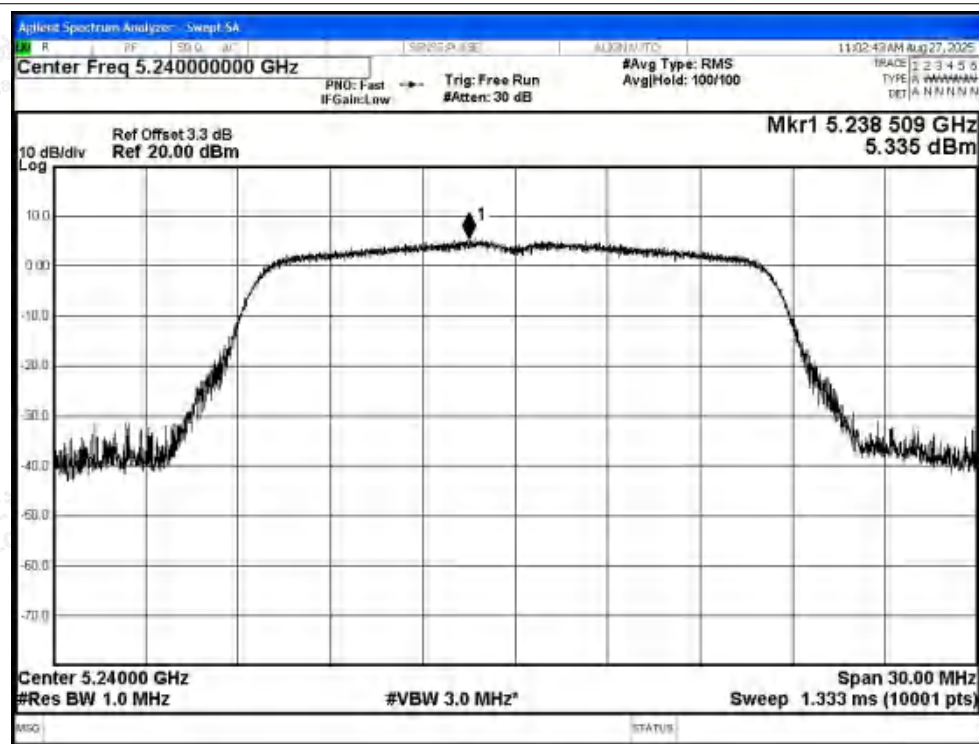

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT n40 5190MHz Ant1

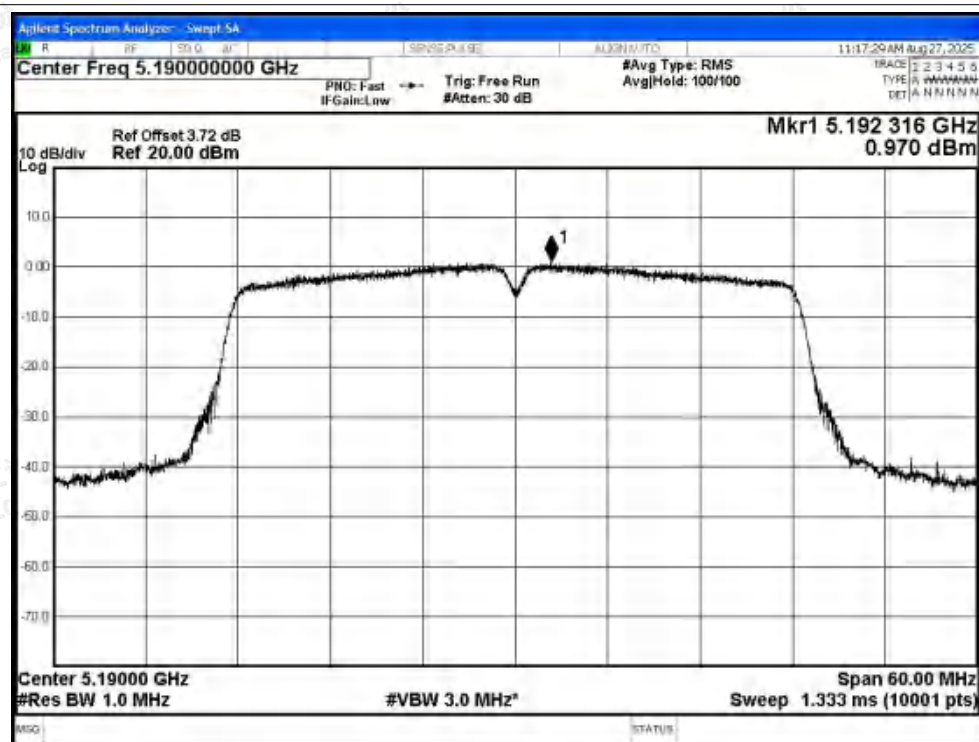

PSD NVNT n40 5230MHz Ant1

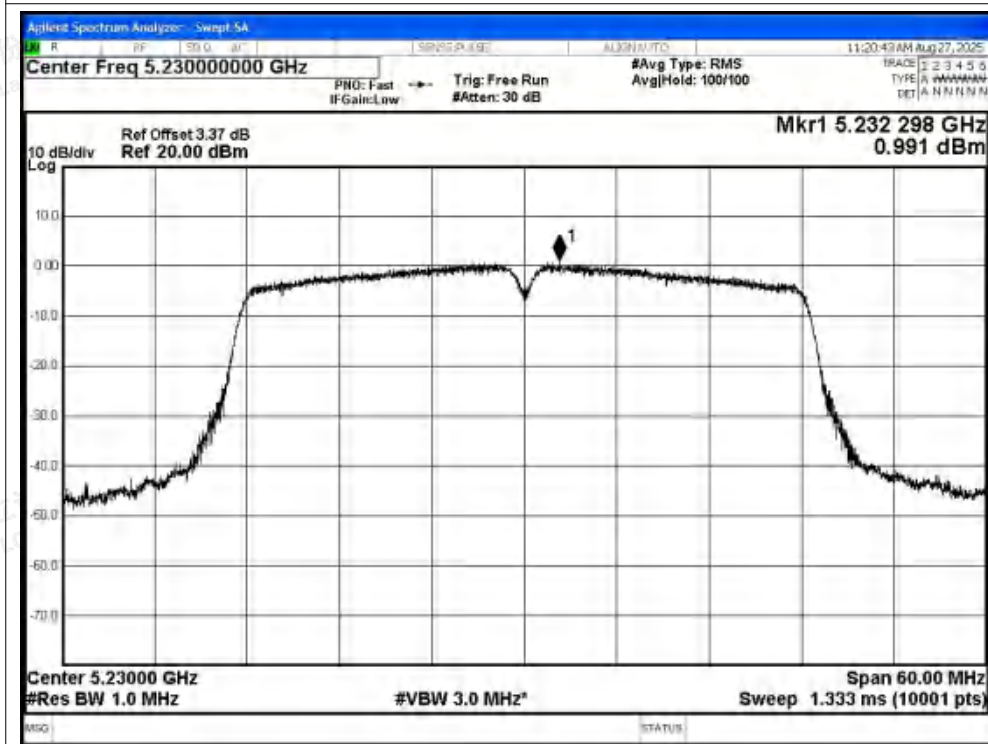

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5180MHz Ant1

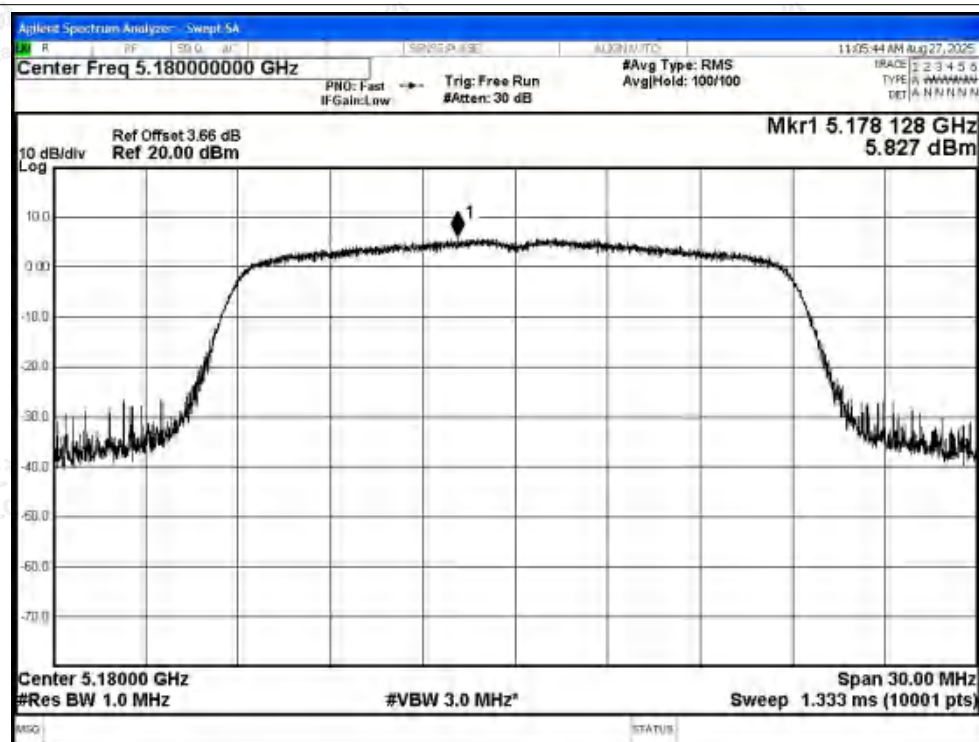


PSD NVNT ac20 5200MHz Ant1

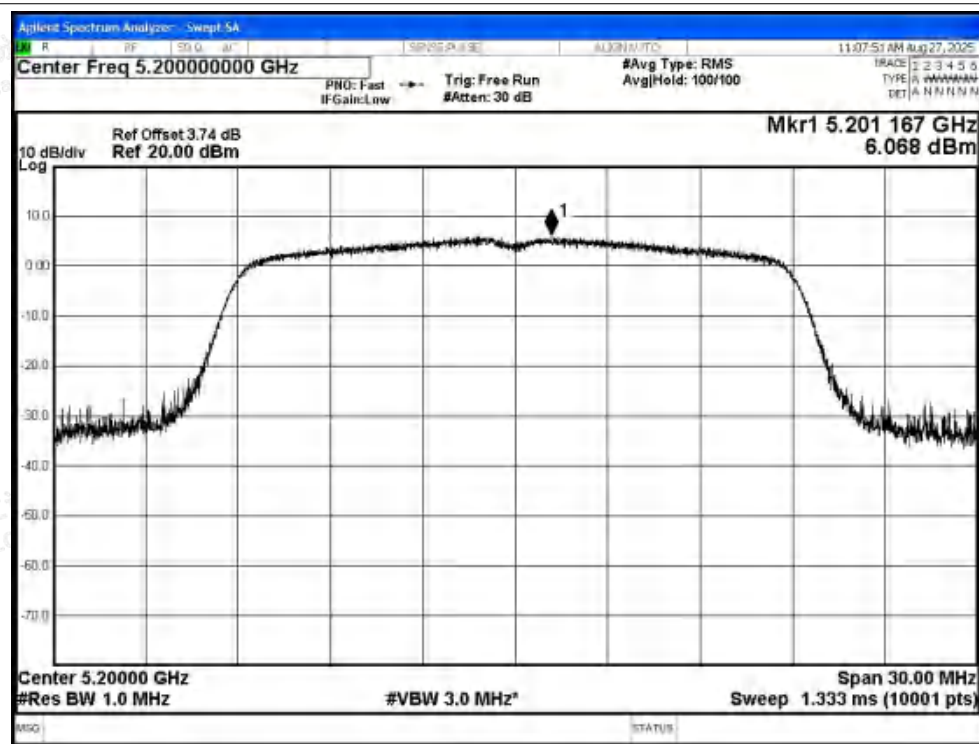




PSD NVNT ac20 5240MHz Ant1

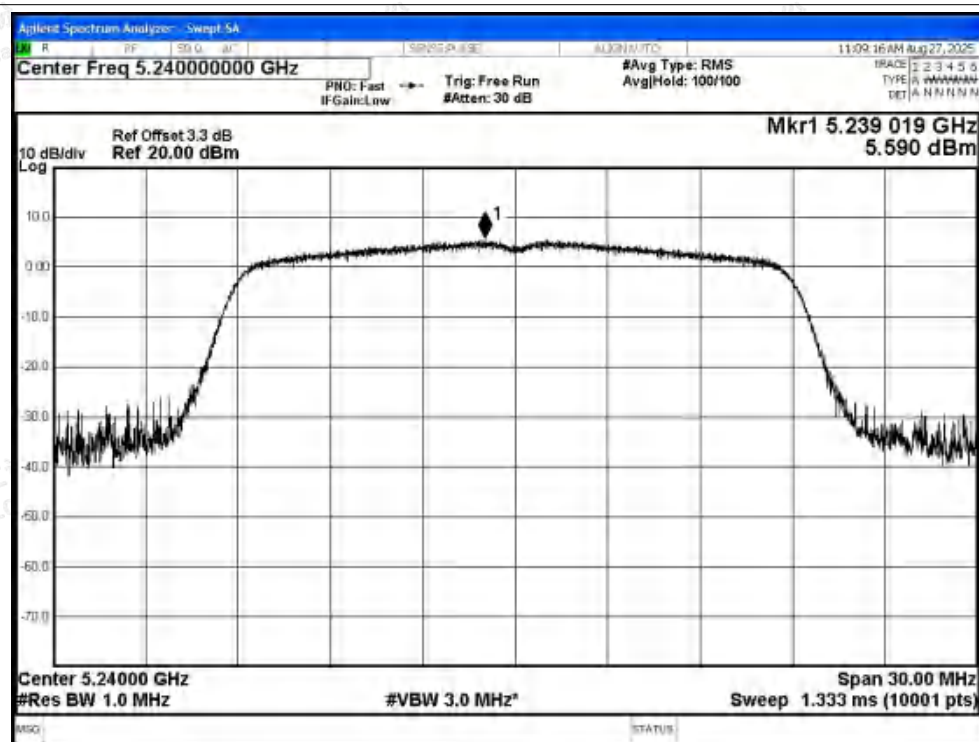


PSD NVNT ac40 5190MHz Ant1

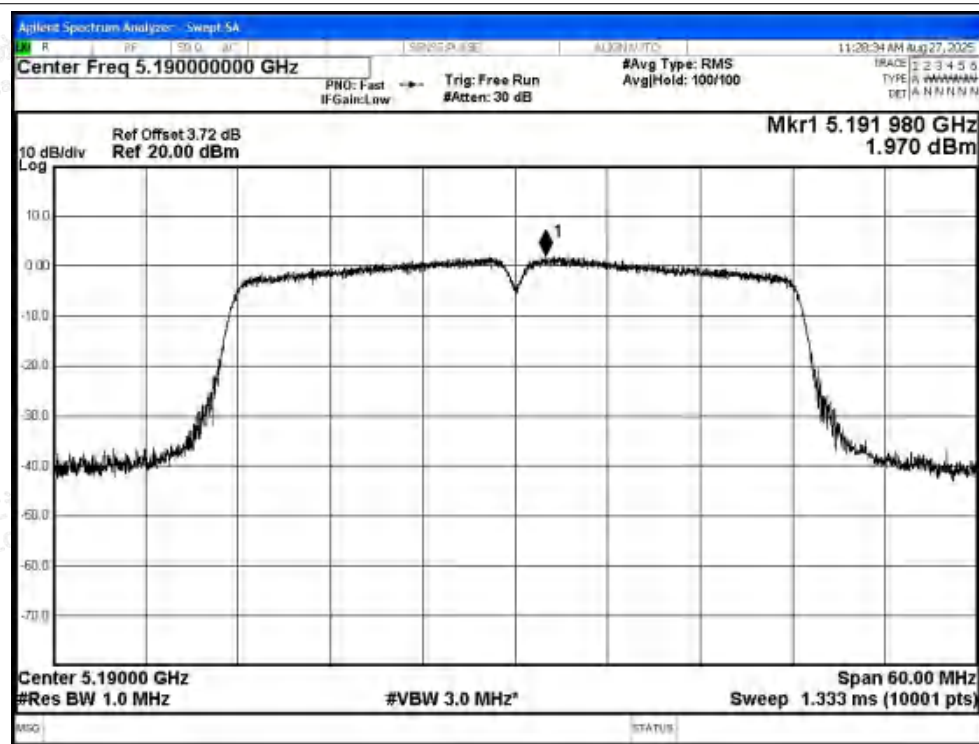




PSD NVNT ac40 5230MHz Ant1

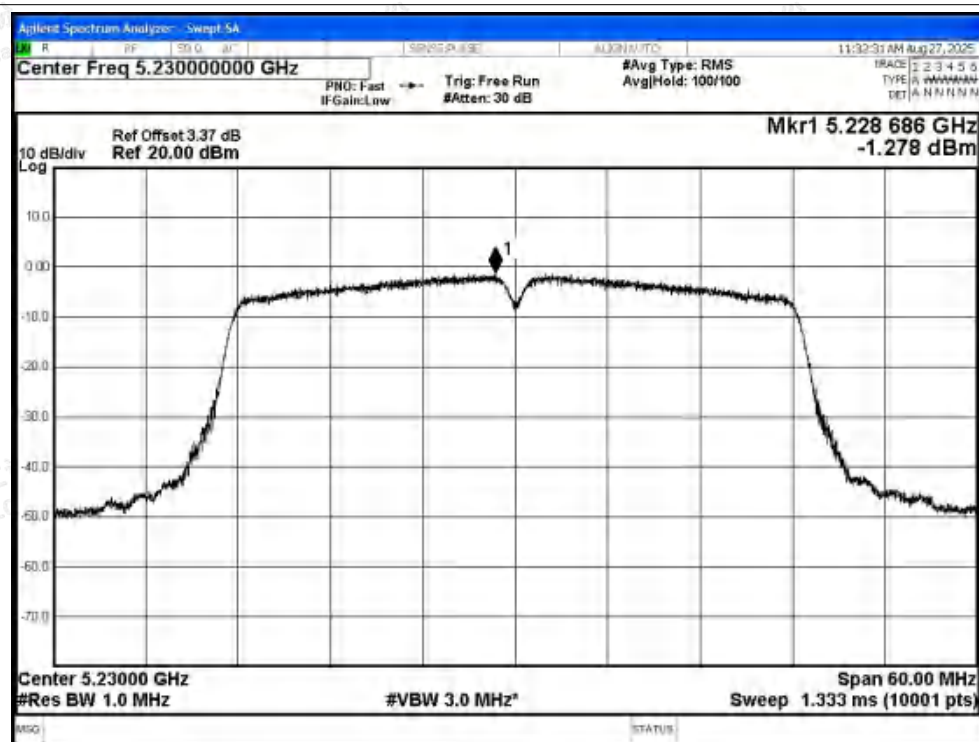


PSD NVNT ac80 5210MHz Ant1

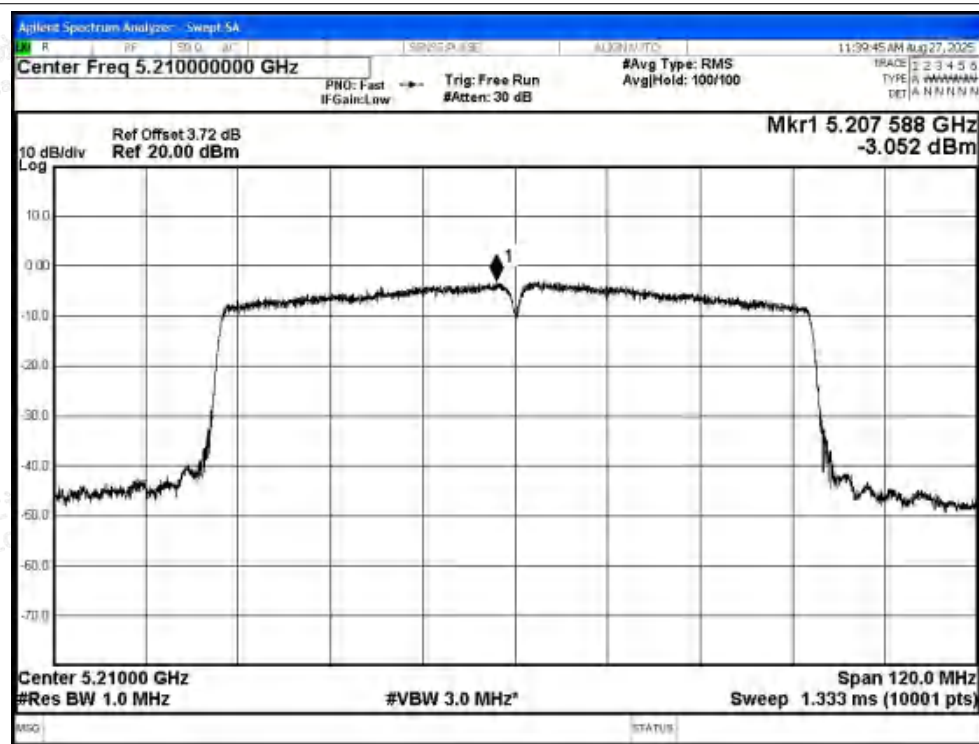




PSD NVNT ax20 5180MHz Ant1

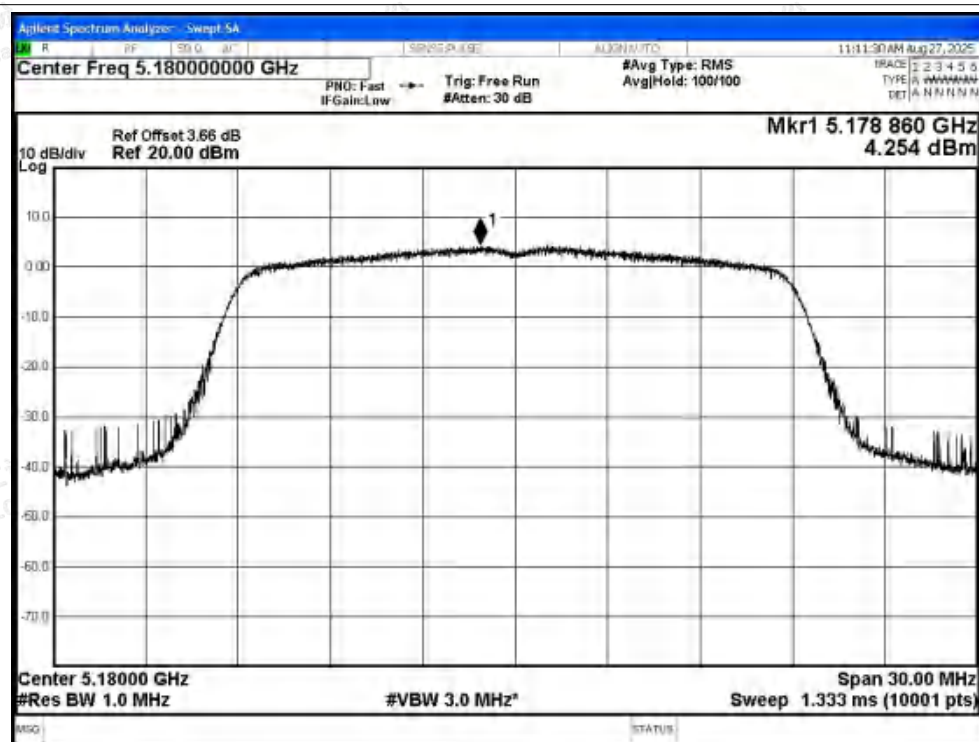

PSD NVNT ax20 5200MHz Ant1

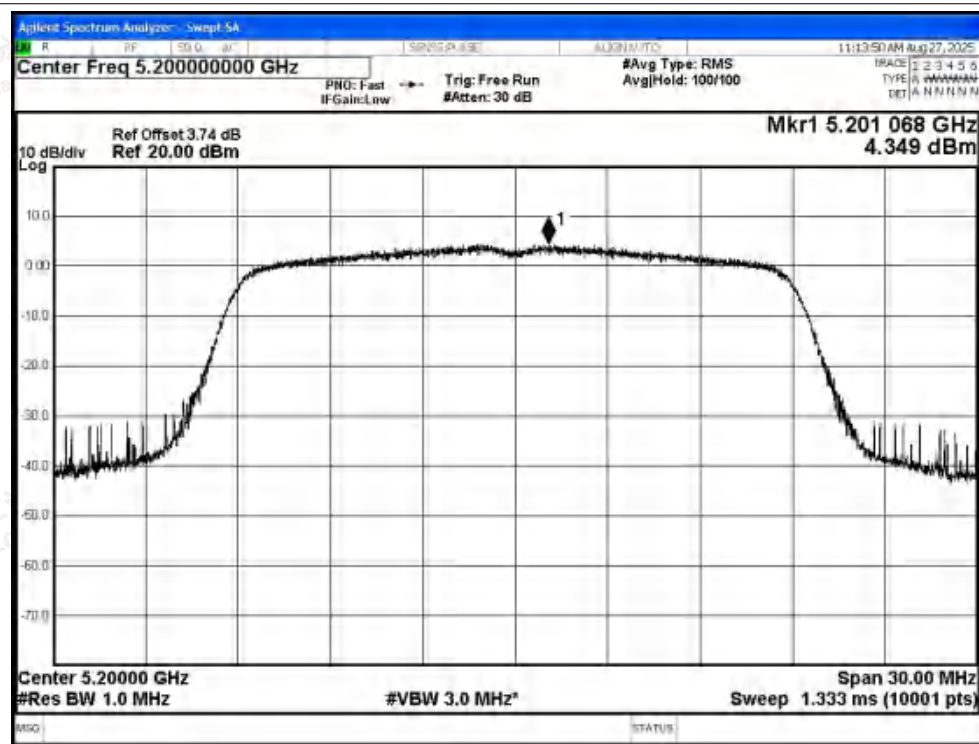

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5240MHz Ant1

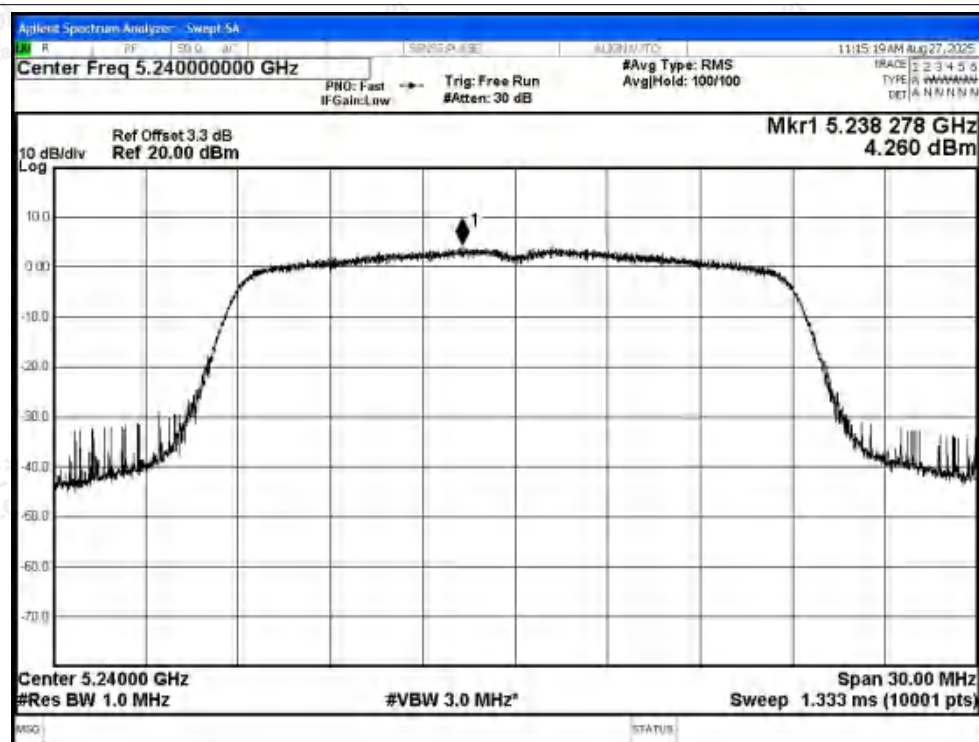


PSD NVNT ax40 5190MHz Ant1

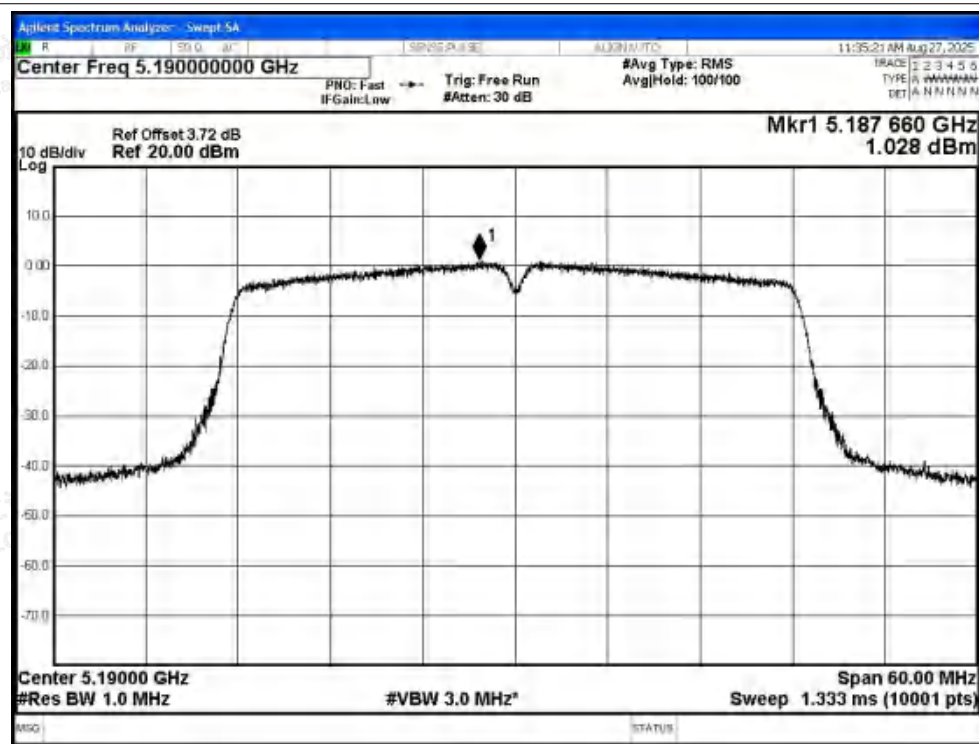





PSD NVNT ax40 5230MHz Ant1

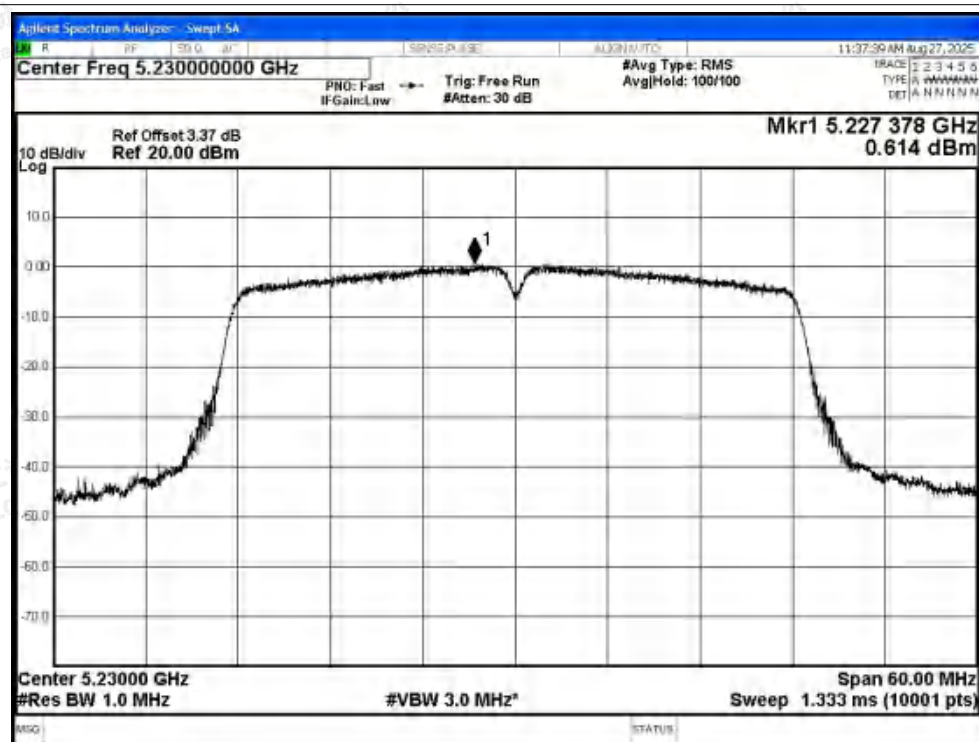


PSD NVNT ax80 5210MHz Ant1

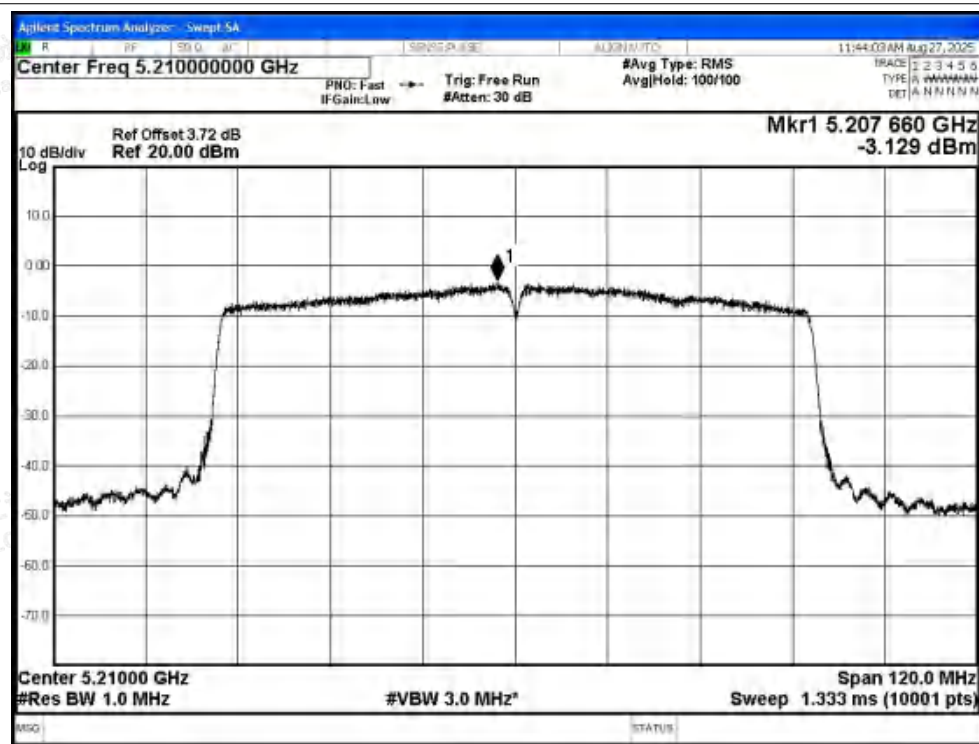




PSD NVNT ac160 5250MHz Ant1

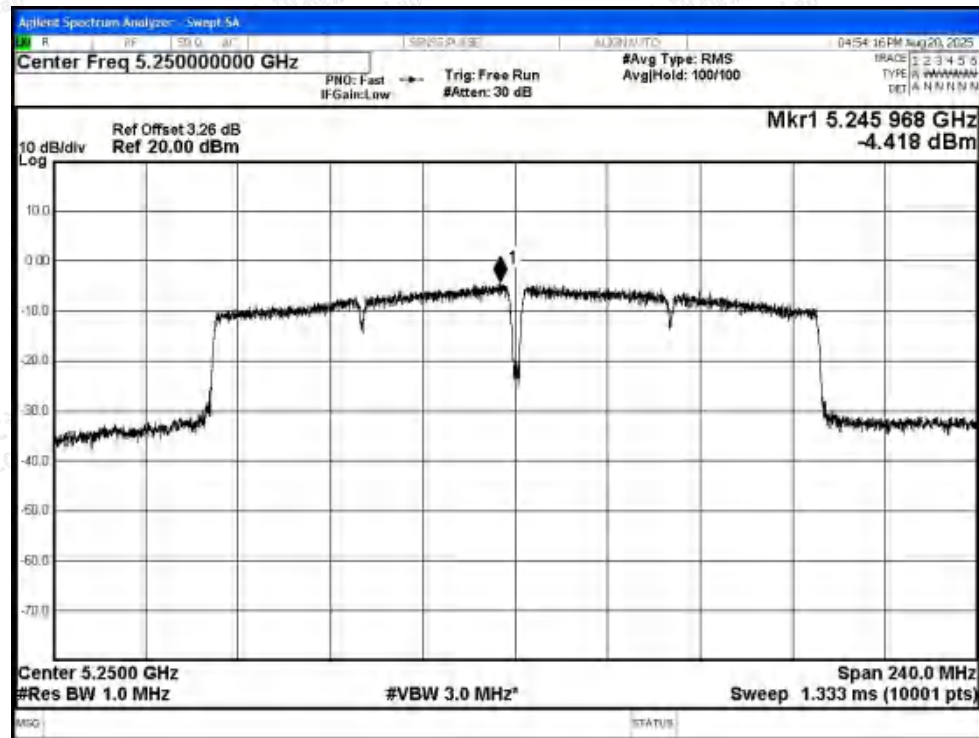

PSD NVNT ax160 5250MHz Ant1

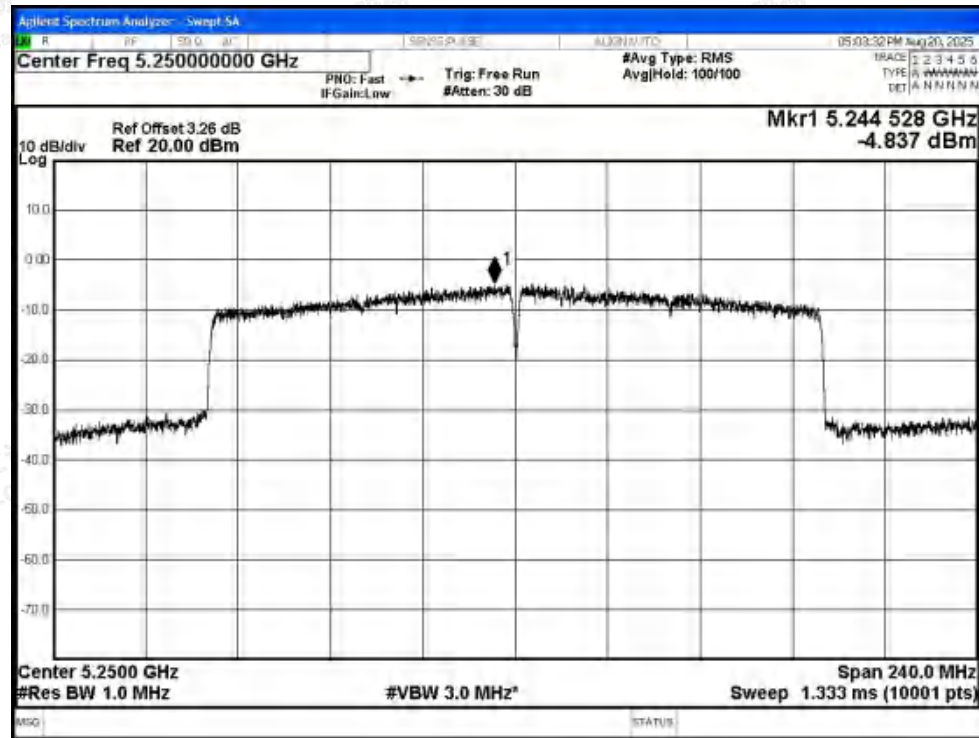


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

PSD NVNT a 5180MHz Ant2

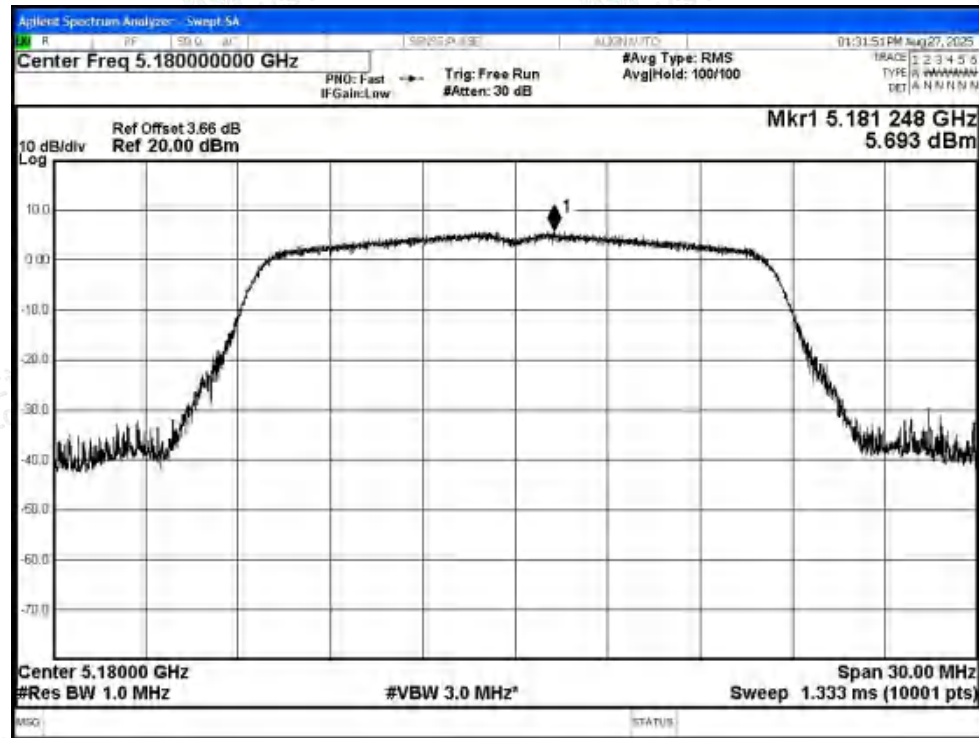

PSD NVNT a 5200MHz Ant2

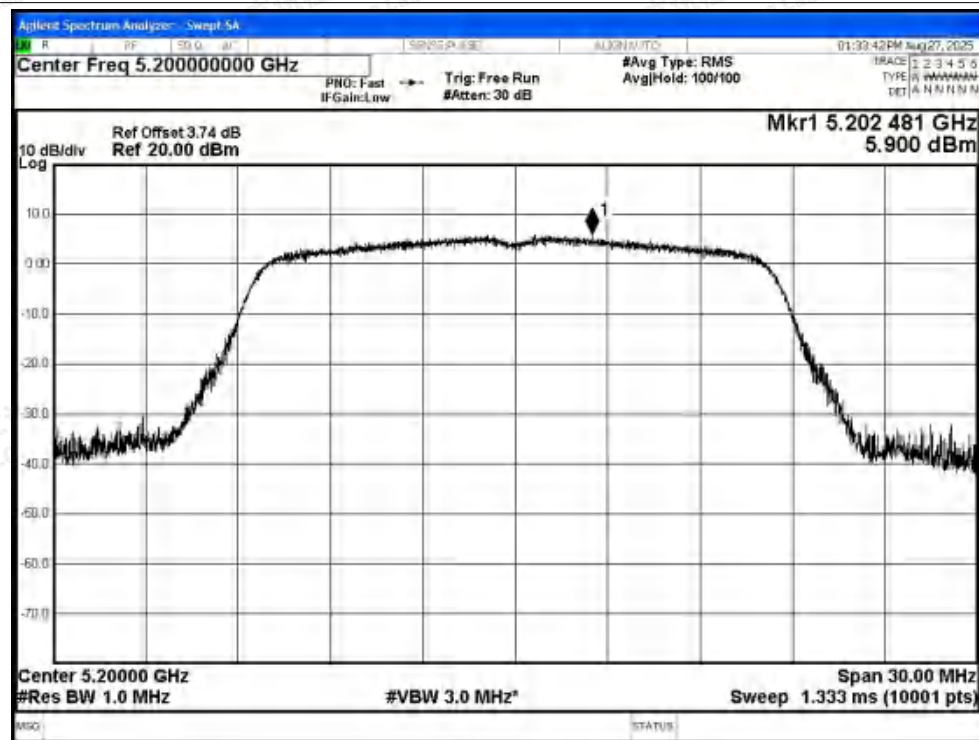

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT a 5240MHz Ant2

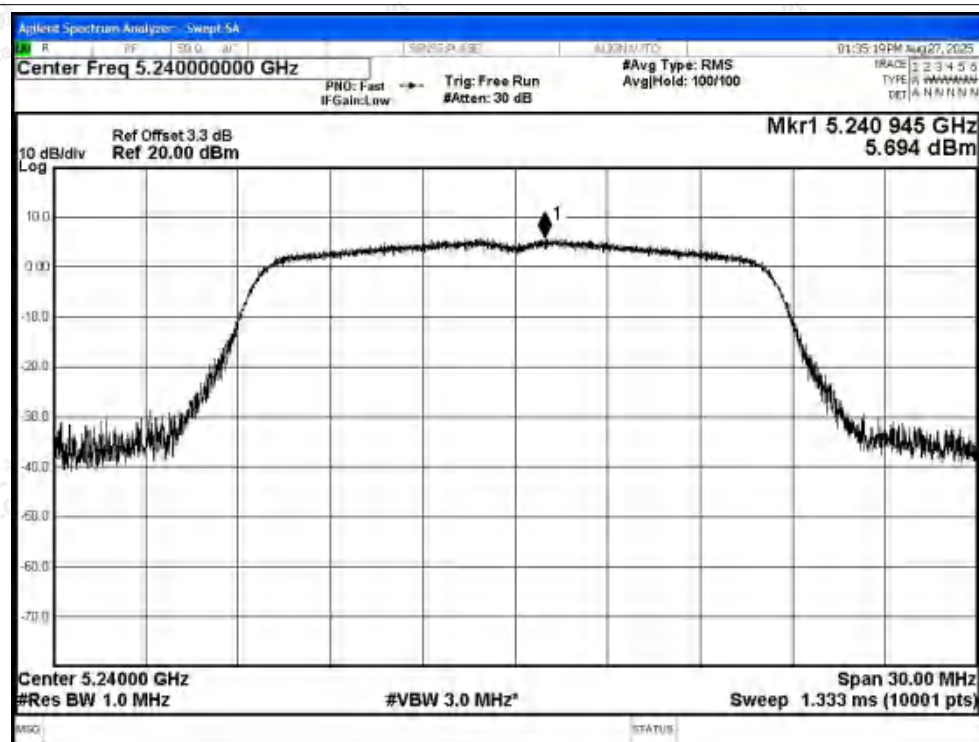

PSD NVNT n20 5180MHz Ant2

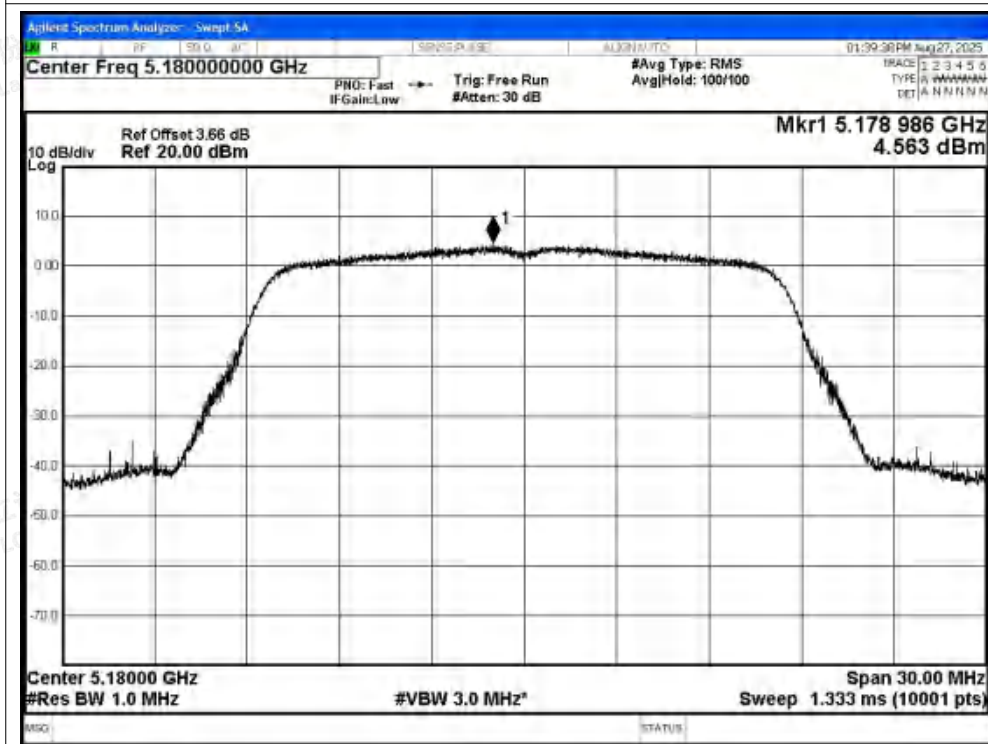

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT n20 5200MHz Ant2

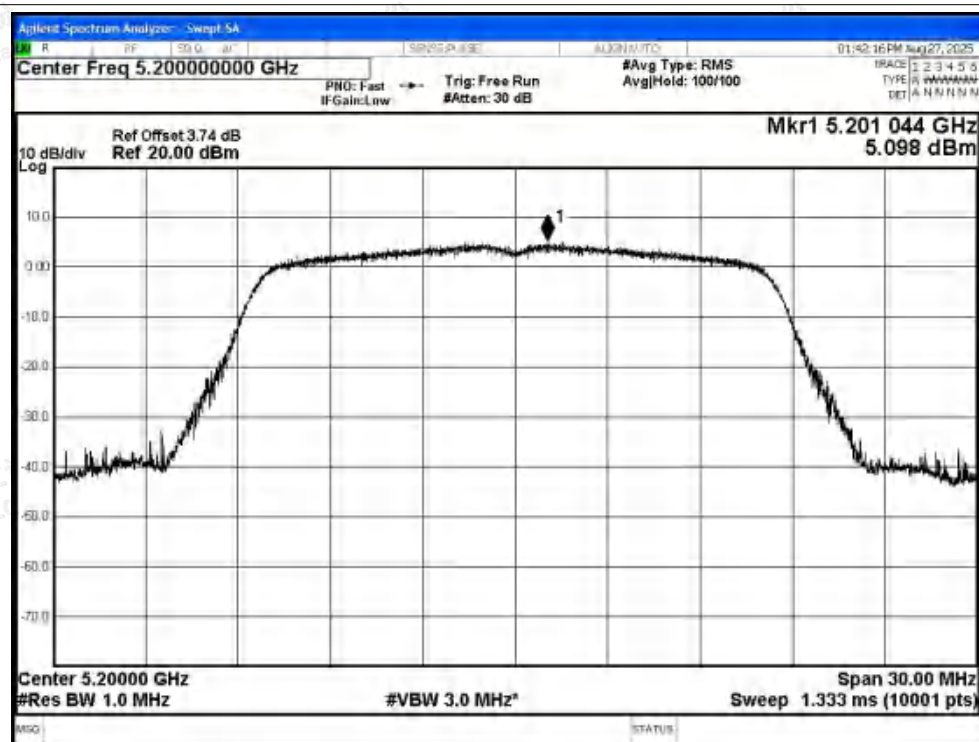

PSD NVNT n20 5240MHz Ant2

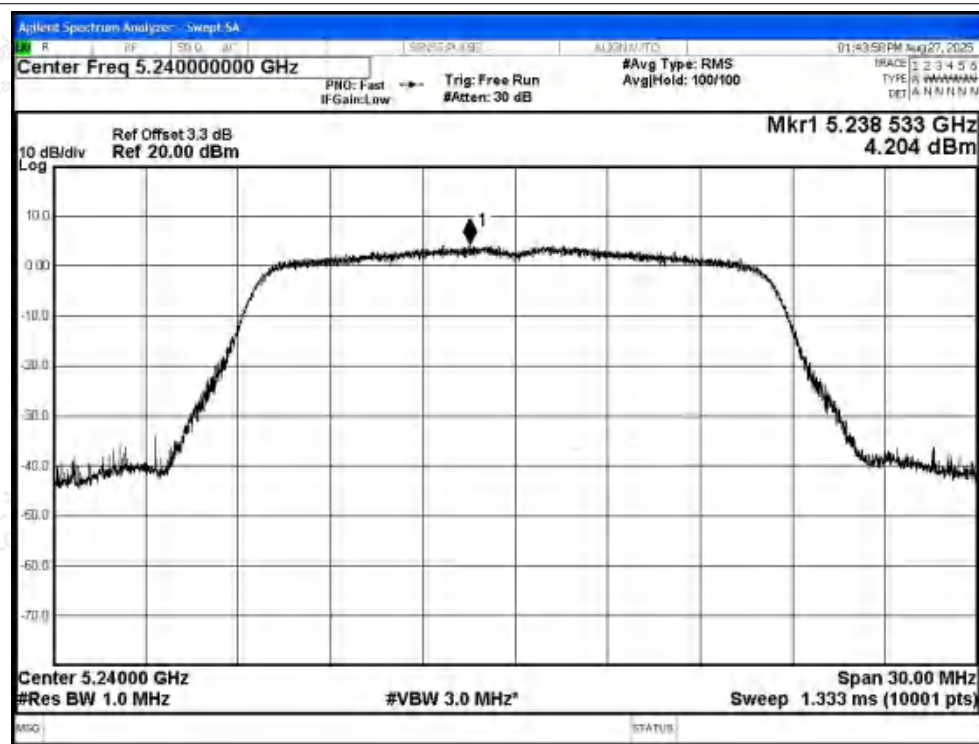

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT n40 5190MHz Ant2

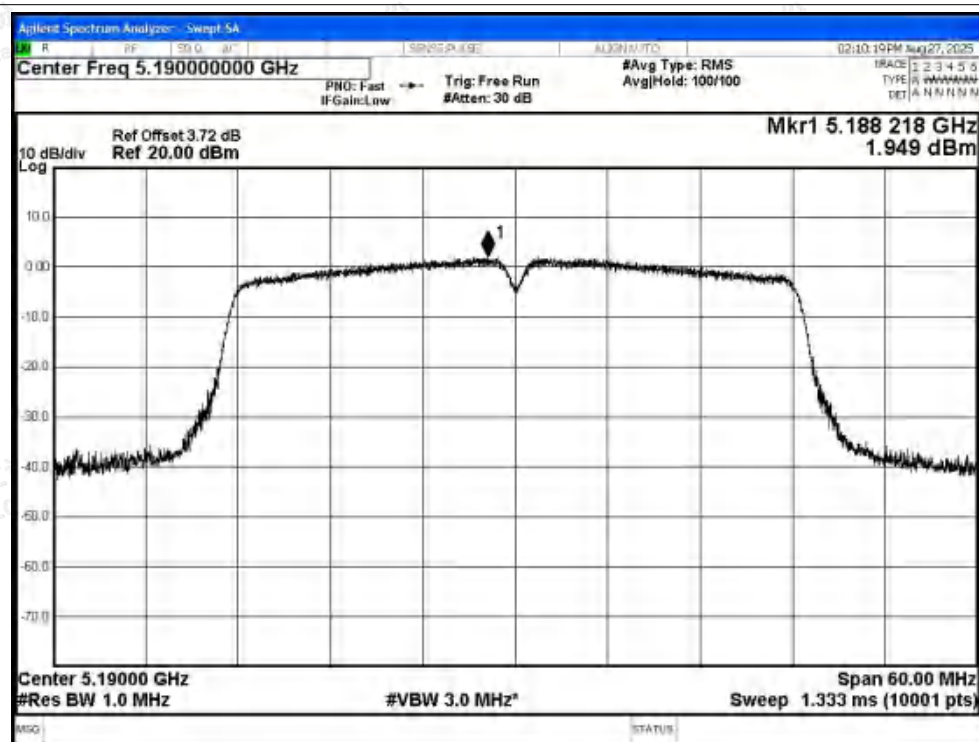


PSD NVNT n40 5230MHz Ant2

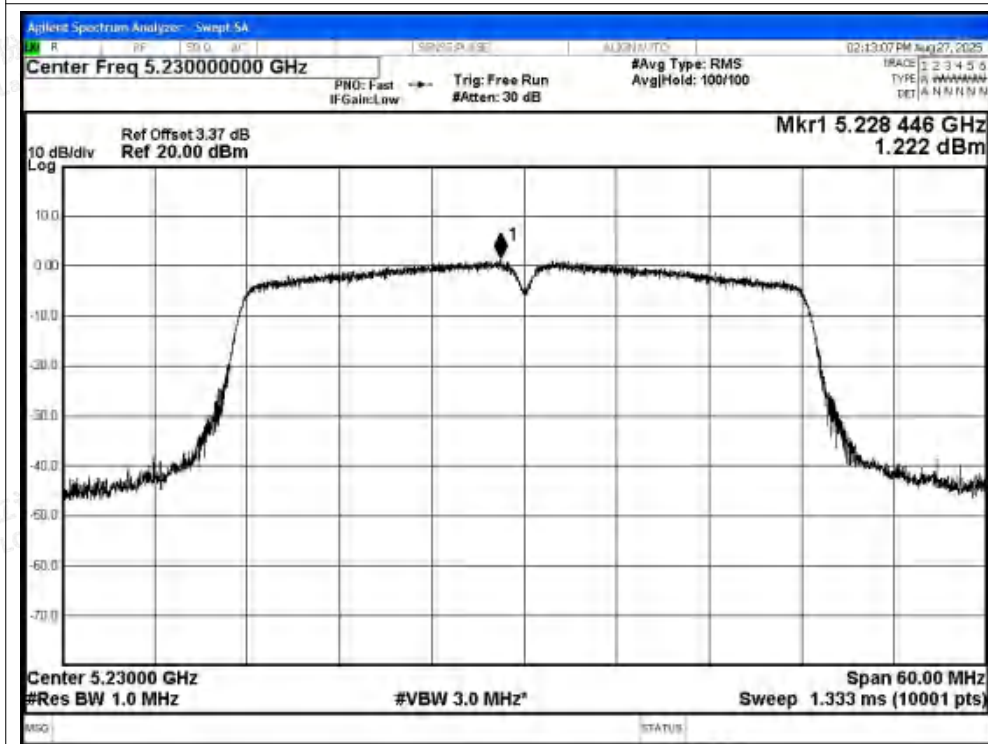




PSD NVNT ac20 5180MHz Ant2

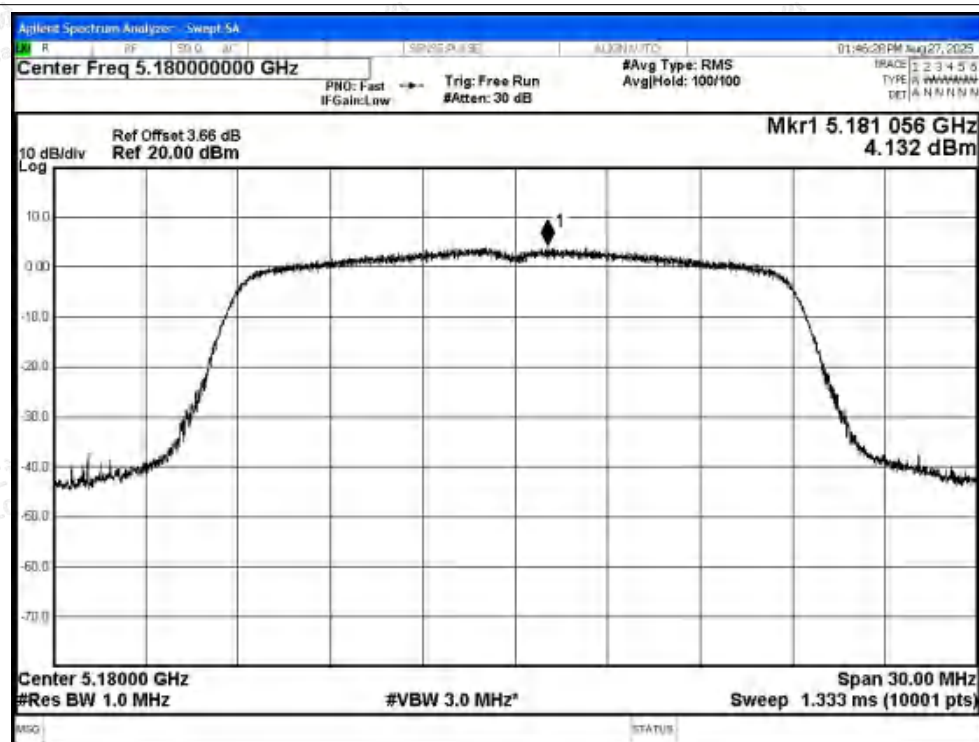

PSD NVNT ac20 5200MHz Ant2

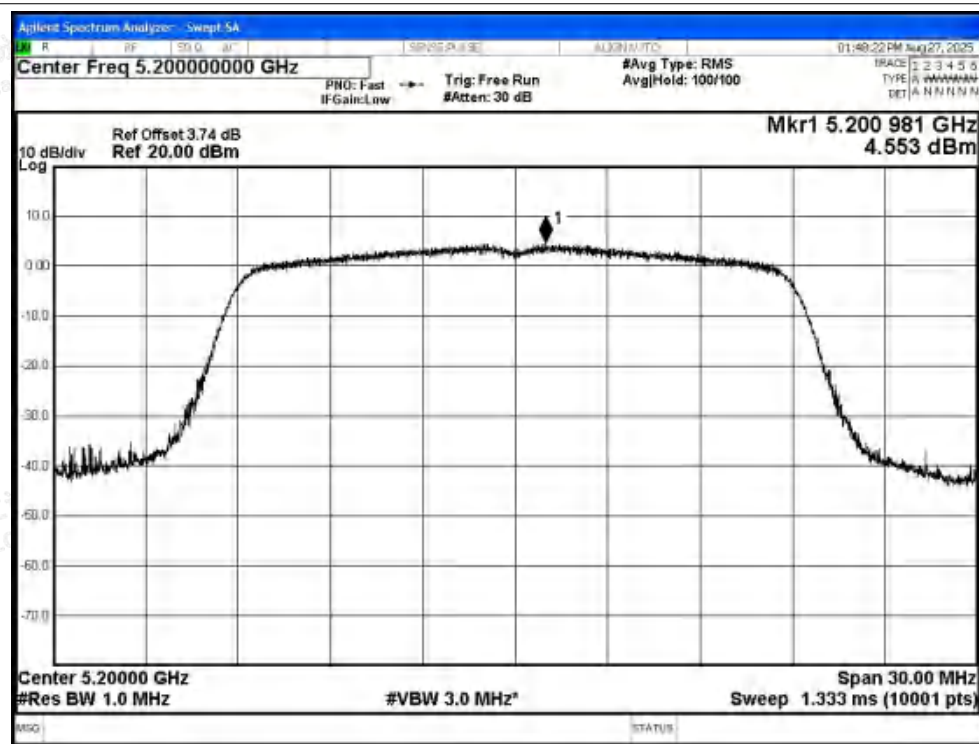

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5240MHz Ant2

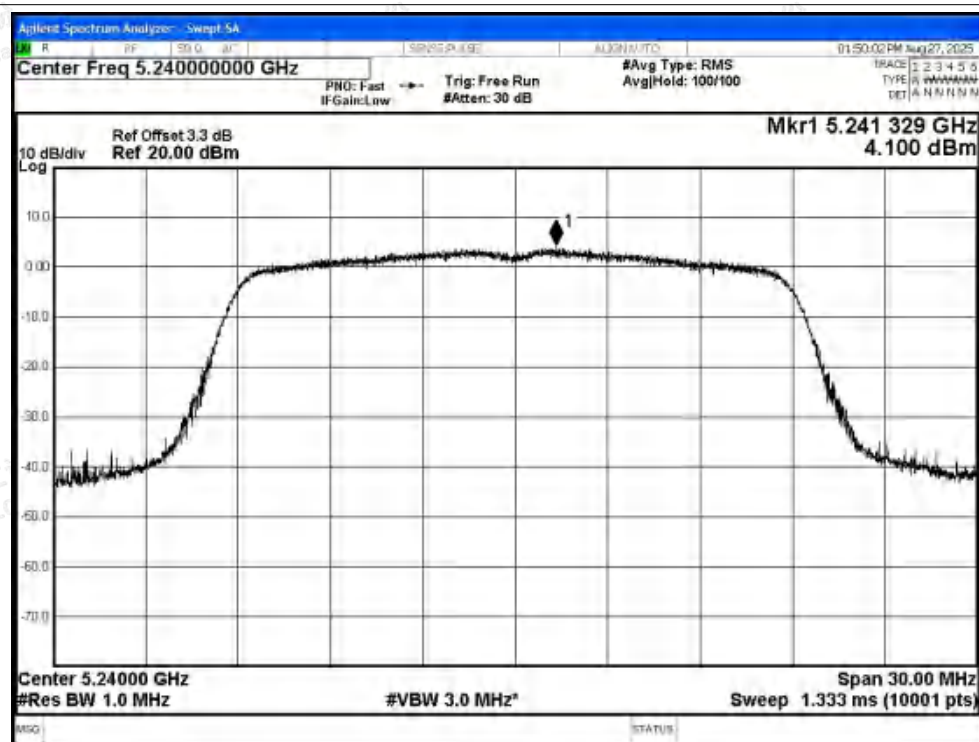

PSD NVNT ac40 5190MHz Ant2

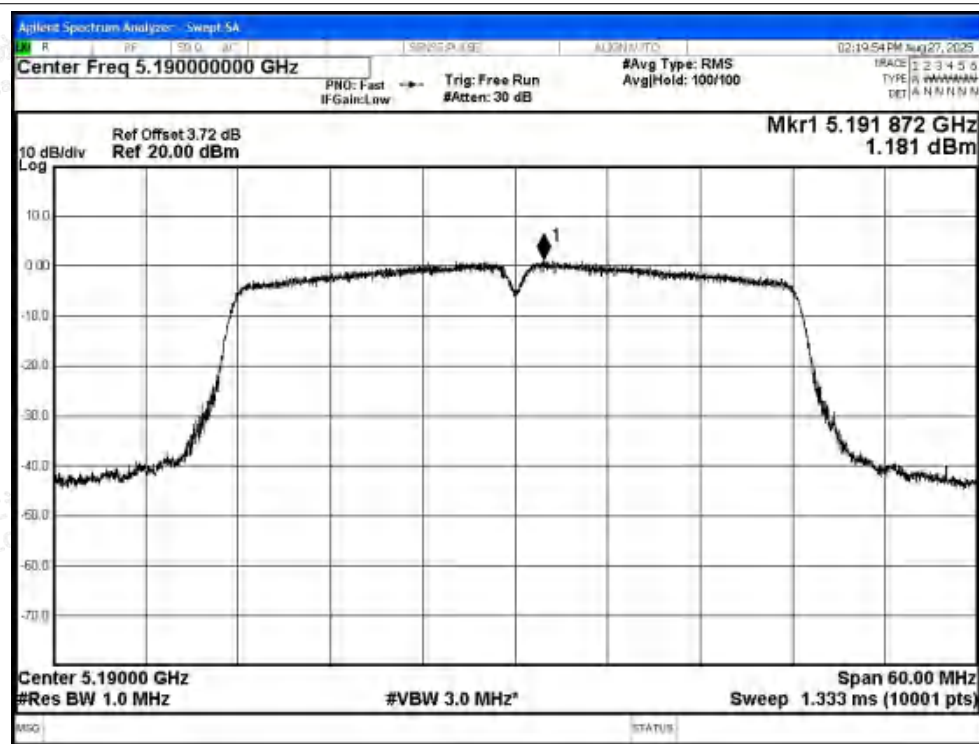

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




PSD NVNT ac40 5230MHz Ant2

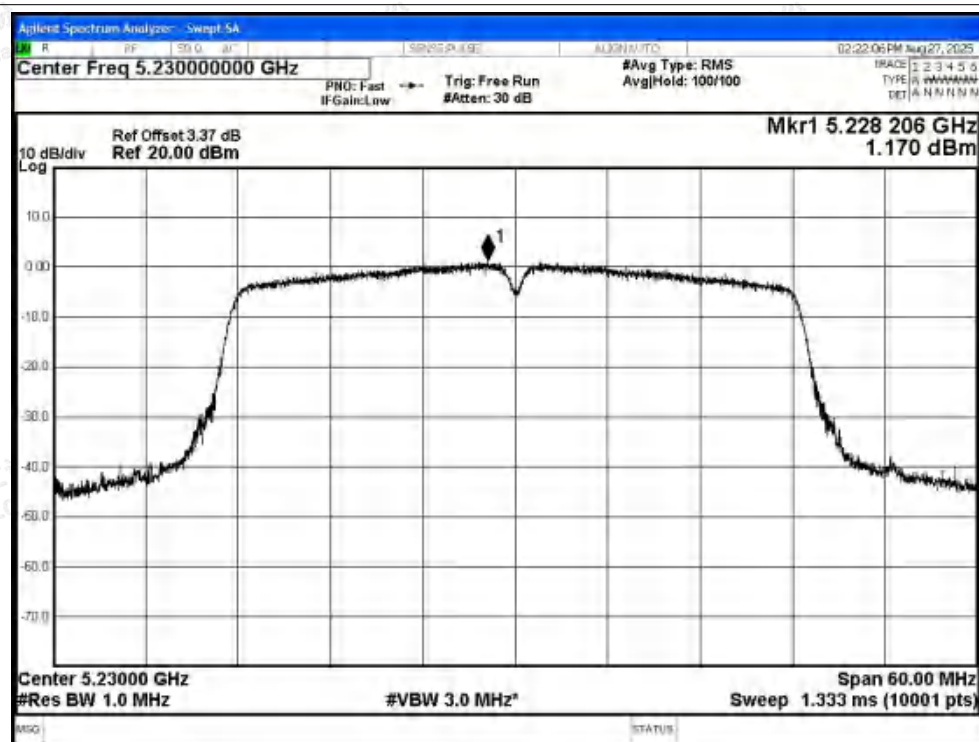


PSD NVNT ac80 5210MHz Ant2

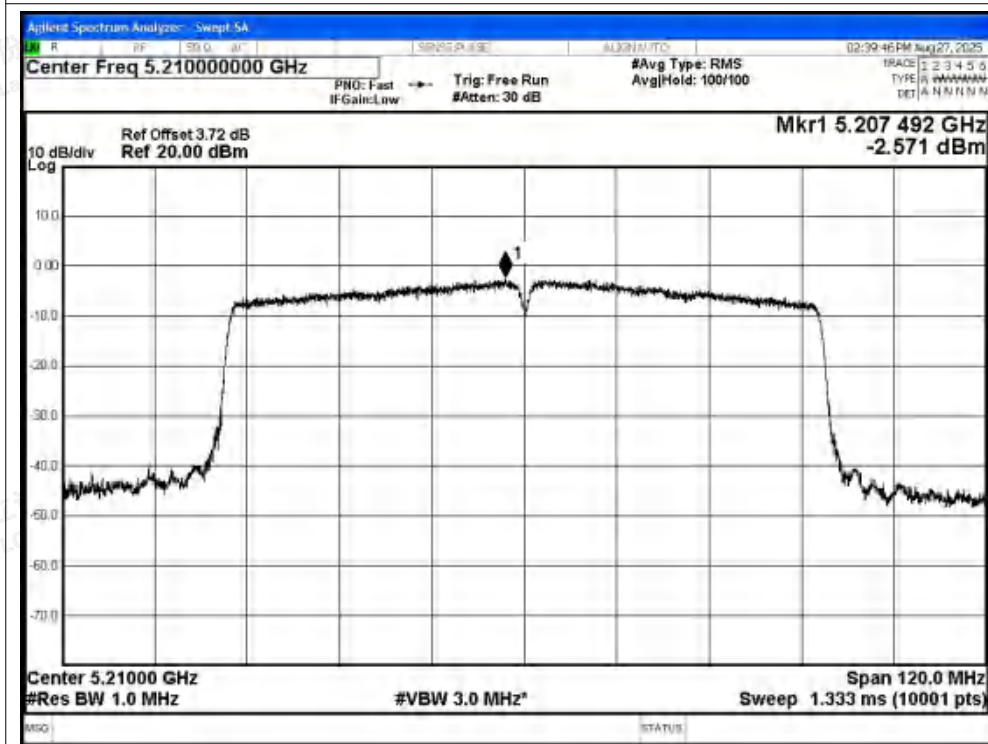




PSD NVNT ax20 5180MHz Ant2

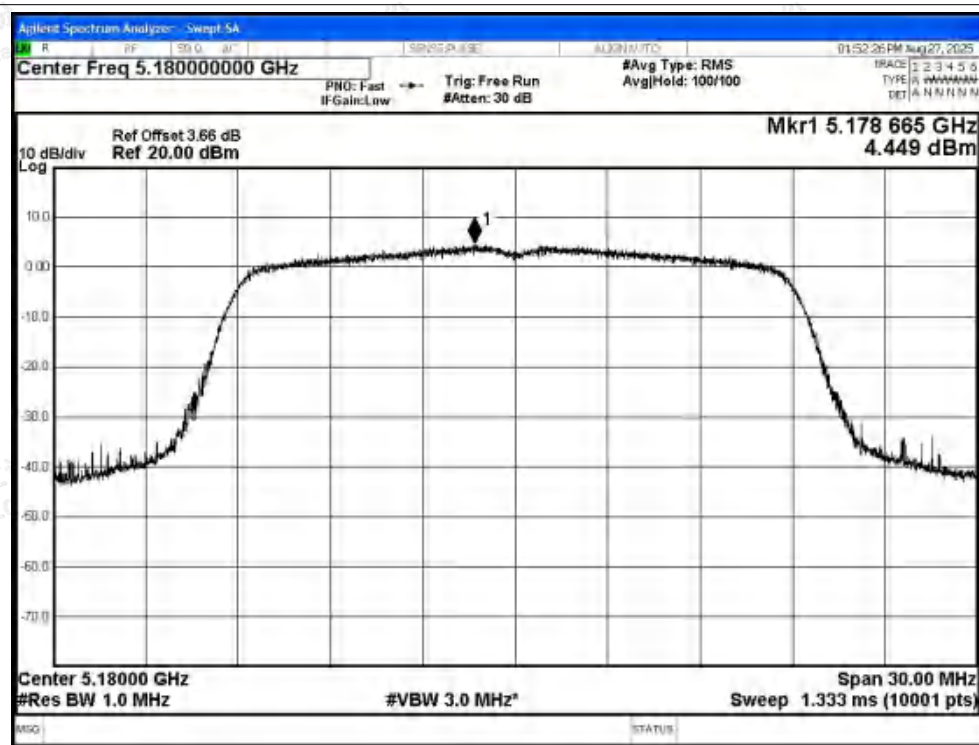

PSD NVNT ax20 5200MHz Ant2

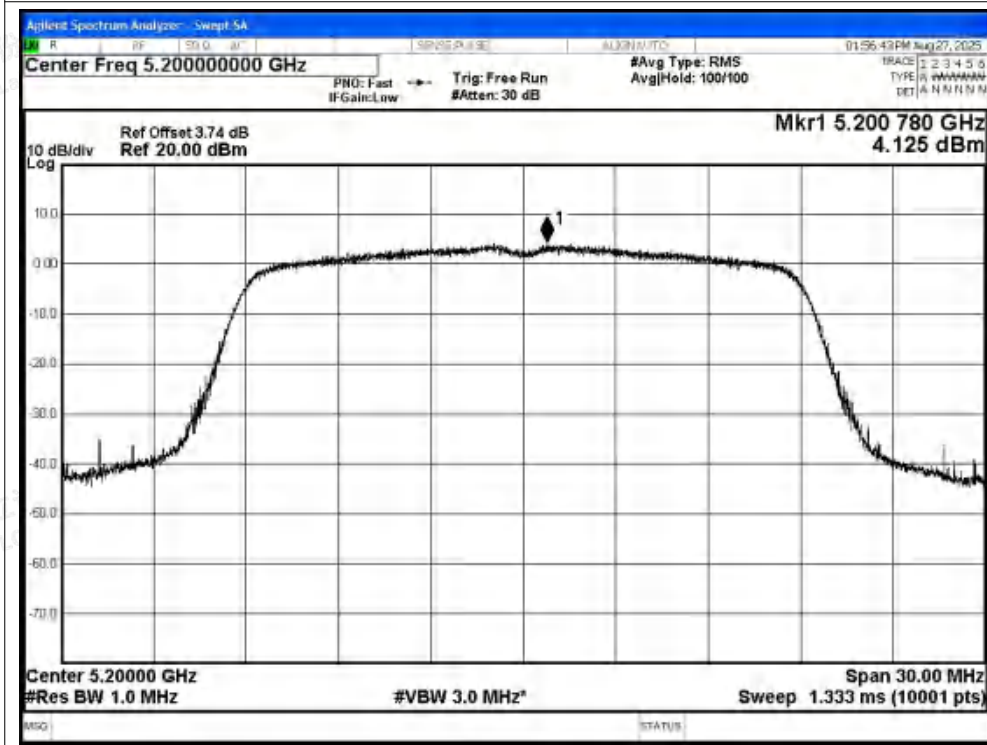

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5240MHz Ant2

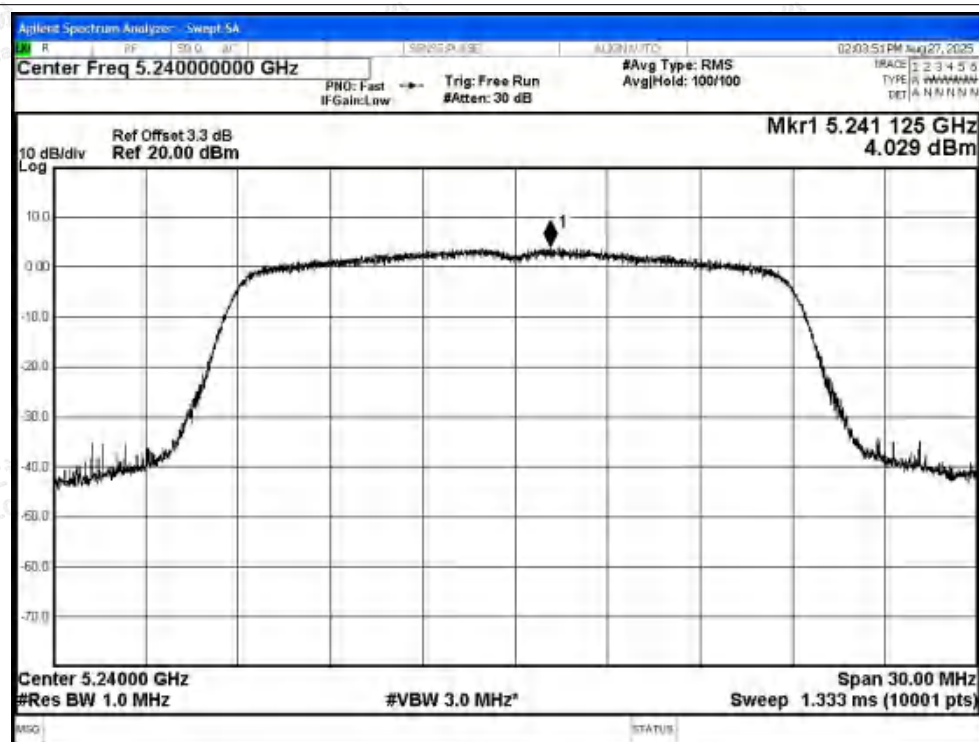


PSD NVNT ax40 5190MHz Ant2

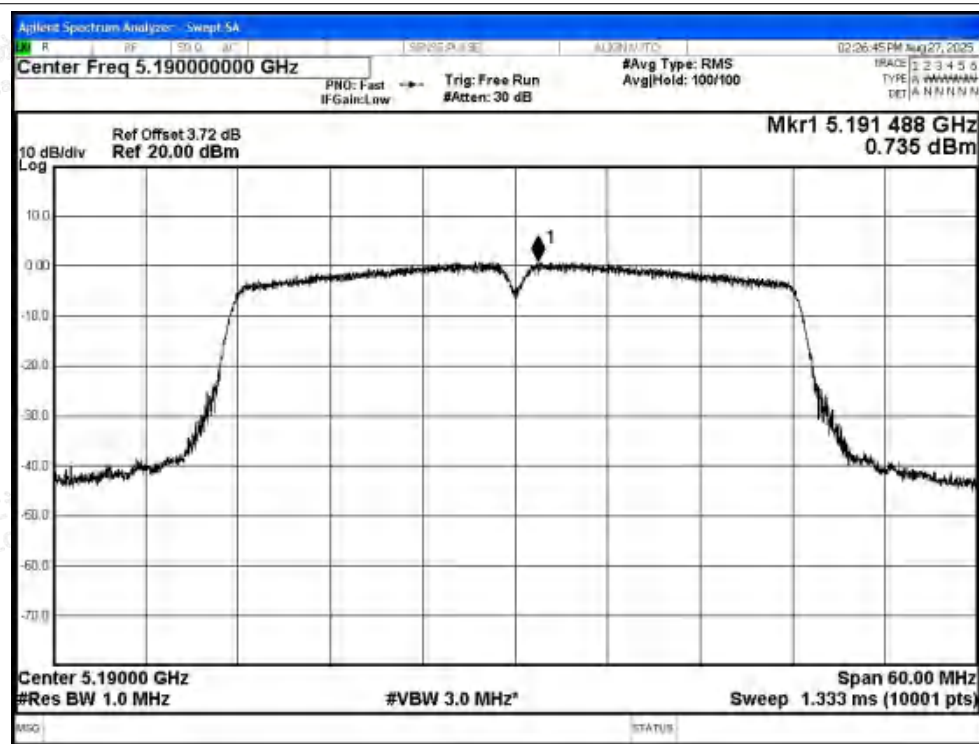




PSD NVNT ax40 5230MHz Ant2

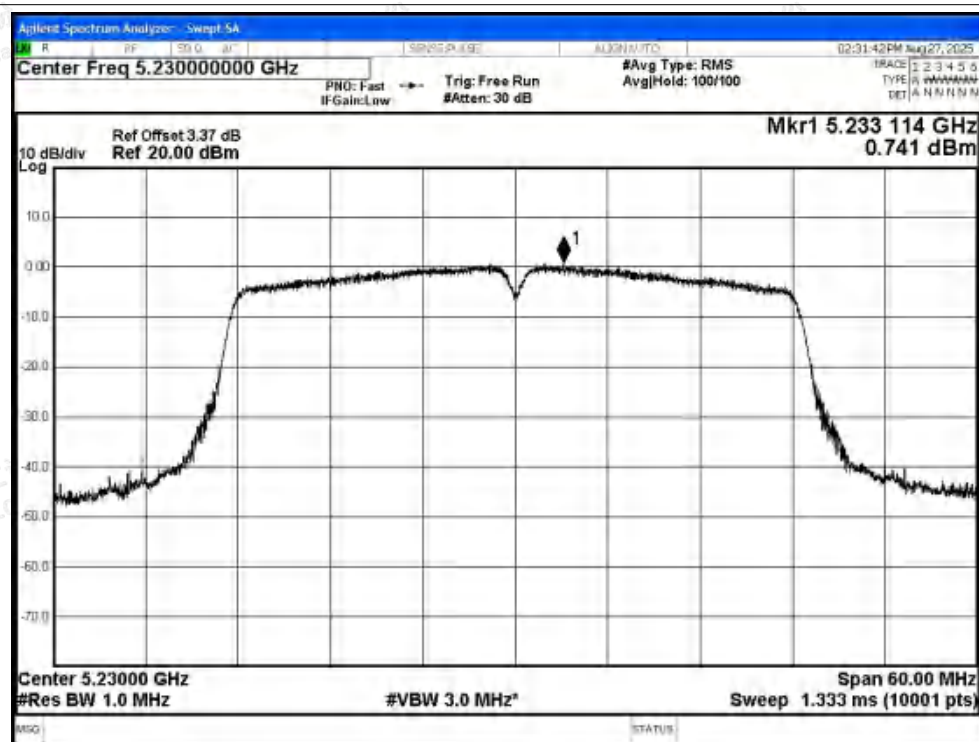

PSD NVNT ax80 5210MHz Ant2

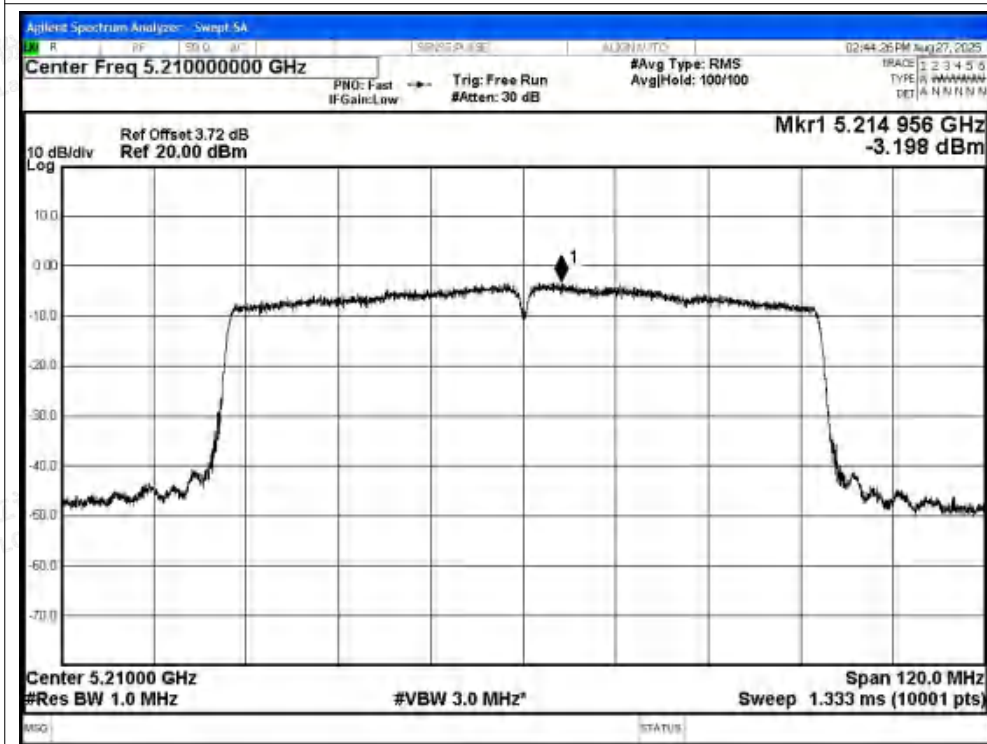

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




PSD NVNT ac160 5250MHz Ant2

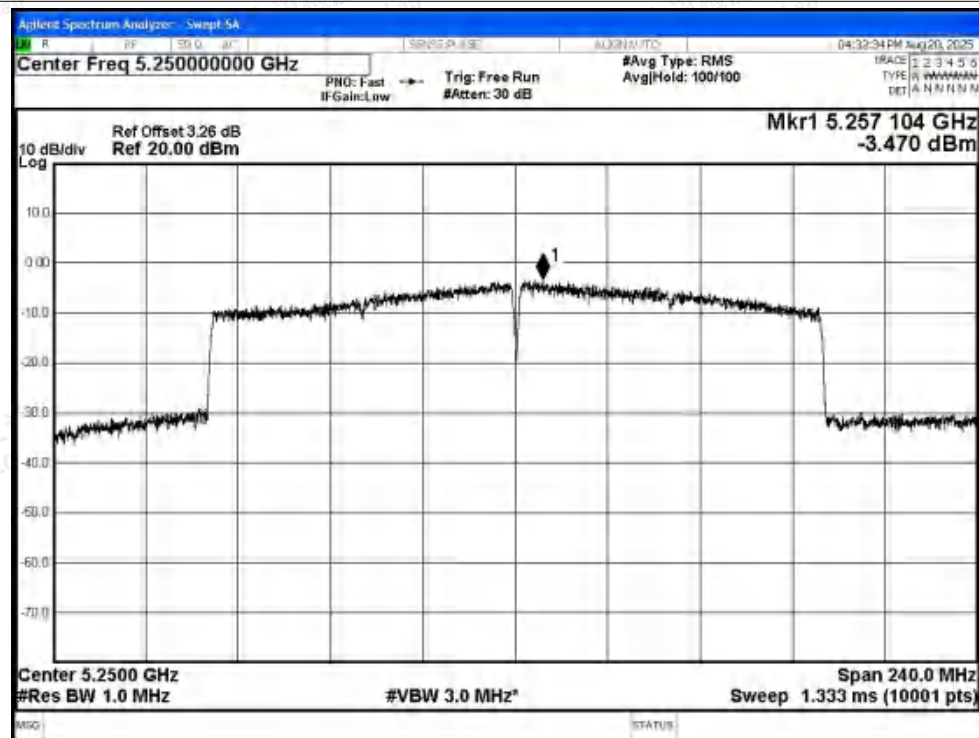

PSD NVNT ax160 5250MHz Ant2

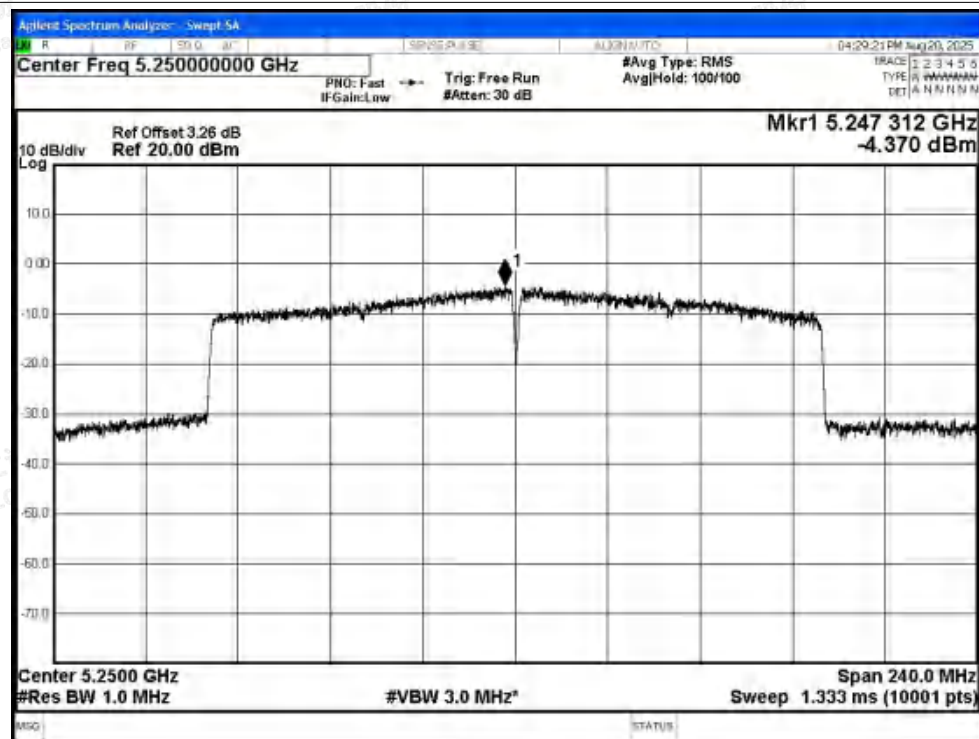



B.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant1	4500	-59.65	4.94	-	40.52	Peak	68.2	Pass
NVNT	a	5180	Ant1	4500	-68.01	4.94	0.11	32.27	Average	54	Pass
NVNT	a	5180	Ant1	5147.5	-45.45	4.94	-	54.72	Peak	68.2	Pass
NVNT	a	5180	Ant1	5149.6	-59.19	4.94	0.11	41.09	Average	54	Pass
NVNT	a	5180	Ant1	5150	-47.48	4.94	-	52.69	Peak	68.2	Pass
NVNT	a	5180	Ant1	5150	-59.77	4.94	0.11	40.51	Average	54	Pass
NVNT	a	5240	Ant1	5350	-56.41	4.94	-	43.76	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350	-65.88	4.94	0.11	34.4	Average	54	Pass
NVNT	a	5240	Ant1	5365.44	-55.99	4.94	-	44.18	Peak	68.2	Pass
NVNT	a	5240	Ant1	5351.28	-65.2	4.94	0.11	35.08	Average	54	Pass
NVNT	a	5240	Ant1	5460	-59.95	4.94	-	40.22	Peak	68.2	Pass
NVNT	a	5240	Ant1	5460	-67.6	4.94	0.11	32.68	Average	54	Pass
NVNT	n20	5180	Ant1	4500	-59.43	4.94	-	40.74	Peak	68.2	Pass
NVNT	n20	5180	Ant1	4500	-68.09	4.94	0.11	32.19	Average	54	Pass
NVNT	n20	5180	Ant1	5149.6	-47.79	4.94	-	52.38	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5148.9	-58.49	4.94	0.11	41.79	Average	54	Pass
NVNT	n20	5180	Ant1	5150	-45.34	4.94	-	54.83	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5150	-57.88	4.94	0.11	42.4	Average	54	Pass
NVNT	n20	5240	Ant1	5350	-56.16	4.94	-	44.01	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350	-66.14	4.94	0.11	34.14	Average	54	Pass
NVNT	n20	5240	Ant1	5350.08	-56.16	4.94	-	44.01	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5351.28	-65.62	4.94	0.11	34.66	Average	54	Pass
NVNT	n20	5240	Ant1	5460	-59.74	4.94	-	40.43	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5460	-67.71	4.94	0.11	32.57	Average	54	Pass
NVNT	n40	5190	Ant1	4500	-60.47	4.94	-	39.7	Peak	68.2	Pass
NVNT	n40	5190	Ant1	4500	-68.74	4.94	0.22	31.65	Average	54	Pass
NVNT	n40	5190	Ant1	5149.7	-43.76	4.94	-	56.41	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5148.97	-57.6	4.94	0.22	42.79	Average	54	Pass
NVNT	n40	5190	Ant1	5150	-43.76	4.94	-	56.41	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5150	-57.65	4.94	0.22	42.74	Average	54	Pass
NVNT	n40	5230	Ant1	5350	-59.4	4.94	-	40.77	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350	-66.58	4.94	0.23	33.82	Average	54	Pass
NVNT	n40	5230	Ant1	5398.44	-56.49	4.94	-	43.68	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350.38	-65.96	4.94	0.23	34.44	Average	54	Pass
NVNT	n40	5230	Ant1	5460	-59.85	4.94	-	40.32	Peak	68.2	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5230	Ant1	5460	-67.43	4.94	0.23	32.97	Average	54	Pass
NVNT	ac20	5180	Ant1	4500	-60.7	4.94	-	39.47	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	4500	-67.85	4.94	0.11	32.43	Average	54	Pass
NVNT	ac20	5180	Ant1	5148.9	-43.51	4.94	-	56.66	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5148.9	-59.11	4.94	0.11	41.17	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-47.65	4.94	-	52.52	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-59.83	4.94	0.11	40.45	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-57.48	4.94	-	42.69	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-66.29	4.94	0.11	33.99	Average	54	Pass
NVNT	ac20	5240	Ant1	5447.76	-56.38	4.94	-	43.79	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5352.48	-66.12	4.94	0.11	34.16	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-60.76	4.94	-	39.41	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-68.24	4.94	0.11	32.04	Average	54	Pass
NVNT	ac40	5190	Ant1	4500	-59.96	4.94	-	40.21	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-68.12	4.94	0.22	32.27	Average	54	Pass
NVNT	ac40	5190	Ant1	5149.7	-35.04	4.94	-	65.13	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5148.97	-58.12	4.94	0.22	42.27	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-35.04	4.94	-	65.13	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-58.92	4.94	0.22	41.47	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-58.76	4.94	-	41.41	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-66.19	4.94	0.23	34.21	Average	54	Pass
NVNT	ac40	5230	Ant1	5430.03	-56.69	4.94	-	43.48	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5352.27	-66.13	4.94	0.23	34.27	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-58.35	4.94	-	41.82	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-67.47	4.94	0.23	32.93	Average	54	Pass
NVNT	ac80	5210	Ant1	5350	-57.5	4.94	-	42.67	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350	-66.31	4.94	0.43	34.29	Average	54	Pass
NVNT	ac80	5210	Ant1	5379.48	-56.18	4.94	-	43.99	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5360.67	-65.75	4.94	0.43	34.85	Average	54	Pass
NVNT	ac80	5210	Ant1	5460	-59.34	4.94	-	40.83	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5460	-67.48	4.94	0.43	33.12	Average	54	Pass
NVNT	ac80	5210	Ant1	4500	-58.25	4.94	-	41.92	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-67.85	4.94	0.43	32.75	Average	54	Pass
NVNT	ac80	5210	Ant1	5146.22	-44.55	4.94	-	55.62	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5148.59	-58.04	4.94	0.43	42.56	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-48.29	4.94	-	51.88	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-58.81	4.94	0.43	41.79	Average	54	Pass
NVNT	ax20	5180	Ant1	4500	-59	4.94	-	41.17	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	4500	-68.91	4.94	0.11	31.37	Average	54	Pass
NVNT	ax20	5180	Ant1	5149.6	-43.92	4.94	-	56.25	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5148.9	-59.66	4.94	0.11	40.62	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5180	Ant1	5150	-45.47	4.94	-	54.7	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5150	-58.19	4.94	0.11	42.09	Average	54	Pass
NVNT	ax20	5240	Ant1	5350	-58.55	4.94	-	41.62	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5350	-65.9	4.94	0.12	34.39	Average	54	Pass
NVNT	ax20	5240	Ant1	5400.48	-56.46	4.94	-	43.71	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5350.08	-65.9	4.94	0.12	34.39	Average	54	Pass
NVNT	ax20	5240	Ant1	5460	-60.52	4.94	-	39.65	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5460	-67.76	4.94	0.12	32.53	Average	54	Pass
NVNT	ax40	5190	Ant1	4500	-59.81	4.94	-	40.36	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	4500	-68.6	4.94	0.22	31.79	Average	54	Pass
NVNT	ax40	5190	Ant1	5148.24	-43.67	4.94	-	56.5	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5149.7	-57.74	4.94	0.22	42.65	Average	54	Pass
NVNT	ax40	5190	Ant1	5150	-48.47	4.94	-	51.7	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5150	-57.74	4.94	0.22	42.65	Average	54	Pass
NVNT	ax40	5230	Ant1	5350	-57.93	4.94	-	42.24	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5350	-66.27	4.94	0.22	34.12	Average	54	Pass
NVNT	ax40	5230	Ant1	5373.06	-56.54	4.94	-	43.63	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5368.74	-66.27	4.94	0.22	34.12	Average	54	Pass
NVNT	ax40	5230	Ant1	5460	-59.51	4.94	-	40.66	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5460	-68.31	4.94	0.22	32.08	Average	54	Pass
NVNT	ax80	5210	Ant1	5350	-58.07	4.94	-	42.1	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5350	-66.89	4.94	0.43	33.71	Average	54	Pass
NVNT	ax80	5210	Ant1	5458.35	-55.86	4.94	-	44.31	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5351.43	-65.66	4.94	0.43	34.94	Average	54	Pass
NVNT	ax80	5210	Ant1	5460	-59.34	4.94	-	40.83	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5460	-66.86	4.94	0.43	33.74	Average	54	Pass
NVNT	ax80	5210	Ant1	4500	-60.04	4.94	-	40.13	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	4500	-68.08	4.94	0.43	32.52	Average	54	Pass
NVNT	ax80	5210	Ant1	5149.38	-43.96	4.94	-	56.21	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5149.38	-58.44	4.94	0.43	42.16	Average	54	Pass
NVNT	ax80	5210	Ant1	5150	-42.66	4.94	-	57.51	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5150	-58.43	4.94	0.43	42.17	Average	54	Pass

NVNT	ac160	5250	Ant1	5350	-56.73	4.94	-	43.44	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5350	-65.15	4.94	2.81	37.83	Average	54	Pass
NVNT	ac160	5250	Ant1	5356.77	-54.67	4.94	-	45.5	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5350.11	-65.15	4.94	2.81	37.83	Average	54	Pass
NVNT	ac160	5250	Ant1	5460	-56.64	4.94	-	43.53	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5460	-67.53	4.94	2.81	35.45	Average	54	Pass
NVNT	ac160	5250	Ant1	4500	-59.55	4.94	-	40.62	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	4500	-68.76	4.94	2.81	34.22	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac160	5250	Ant1	5144.28	-53.45	4.94	-	46.72	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5147.01	-64.97	4.94	2.81	38.01	Average	54	Pass
NVNT	ac160	5250	Ant1	5150	-57.76	4.94	-	42.41	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5150	-66.05	4.94	2.81	36.93	Average	54	Pass
NVNT	ax160	5250	Ant1	5350	-59.35	4.94	-	40.82	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5350	-66.4	4.94	2.81	36.58	Average	54	Pass
NVNT	ax160	5250	Ant1	5362.69	-54.74	4.94	-	45.43	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5370.09	-65.82	4.94	2.81	37.16	Average	54	Pass
NVNT	ax160	5250	Ant1	5460	-60.04	4.94	-	40.13	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5460	-67.64	4.94	2.81	35.34	Average	54	Pass
NVNT	ax160	5250	Ant1	4500	-60.01	4.94	-	40.16	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	4500	-68.4	4.94	2.81	34.58	Average	54	Pass
NVNT	ax160	5250	Ant1	5143.37	-54.52	4.94	-	45.65	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5144.28	-65	4.94	2.81	37.98	Average	54	Pass
NVNT	ax160	5250	Ant1	5150	-57.6	4.94	-	42.57	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5150	-65.77	4.94	2.81	37.21	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant1 Peak

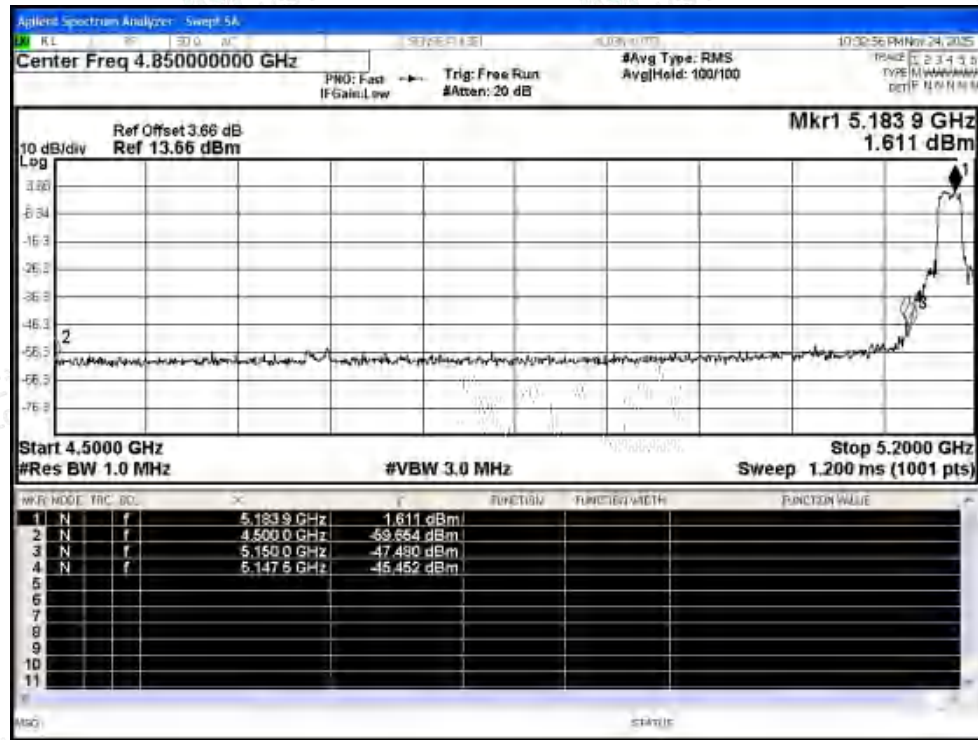

Restrict Band NVNT a 5180MHz Ant1 Average

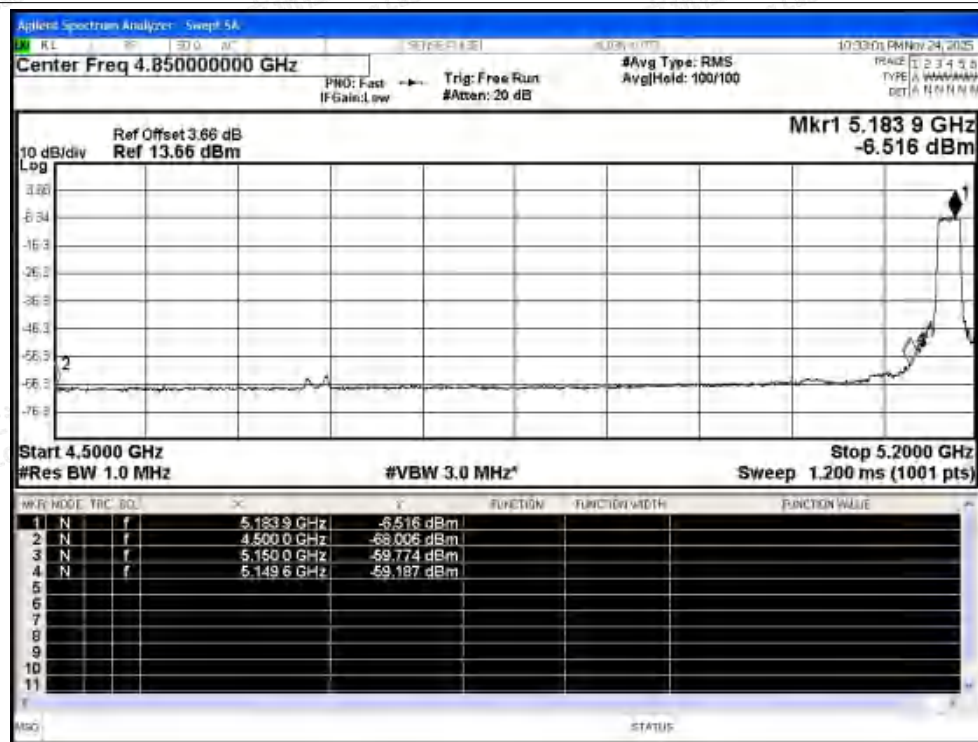

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Restrict Band NVNT a 5240MHz Ant1 Peak

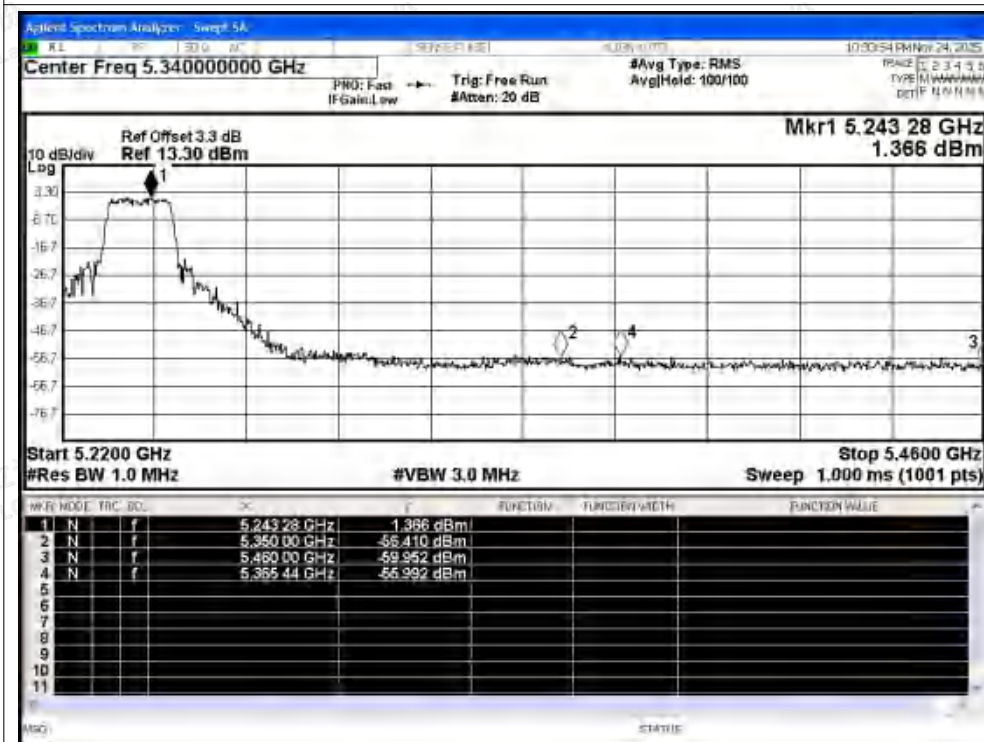


Restrict Band NVNT a 5240MHz Ant1 Average

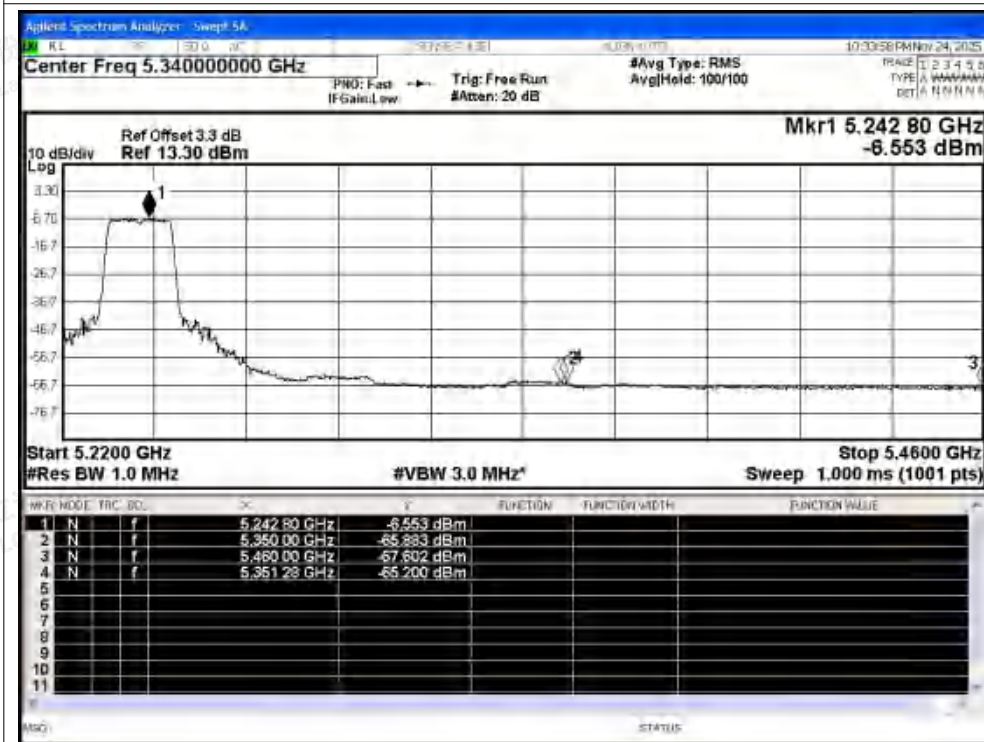




Restrict Band NVNT n20 5180MHz Ant1 Peak

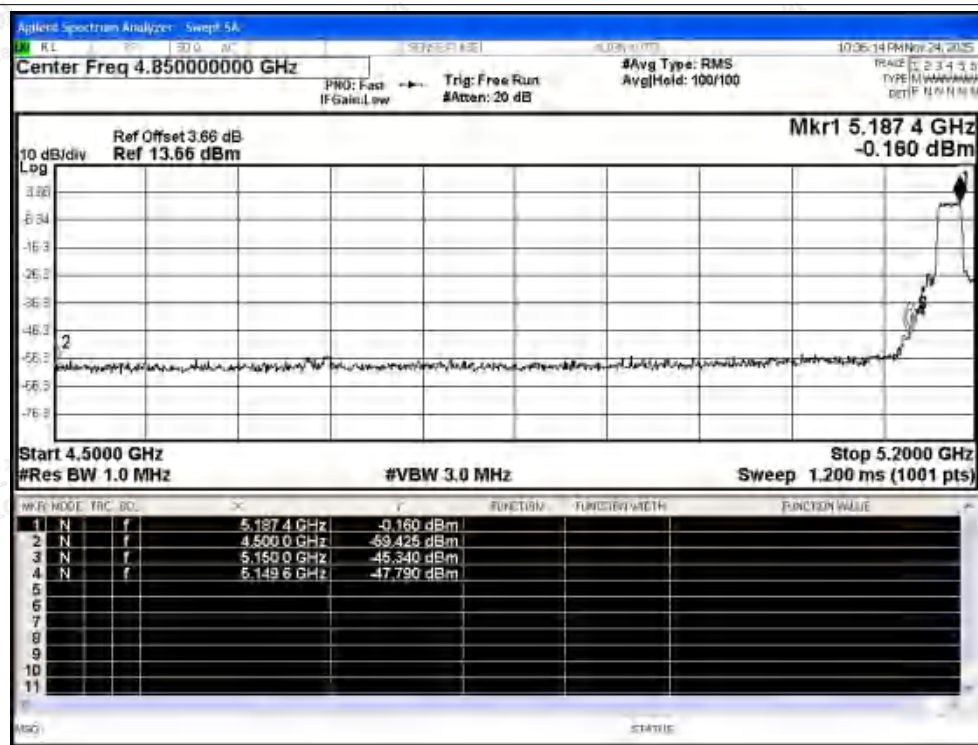

Restrict Band NVNT n20 5180MHz Ant1 Average

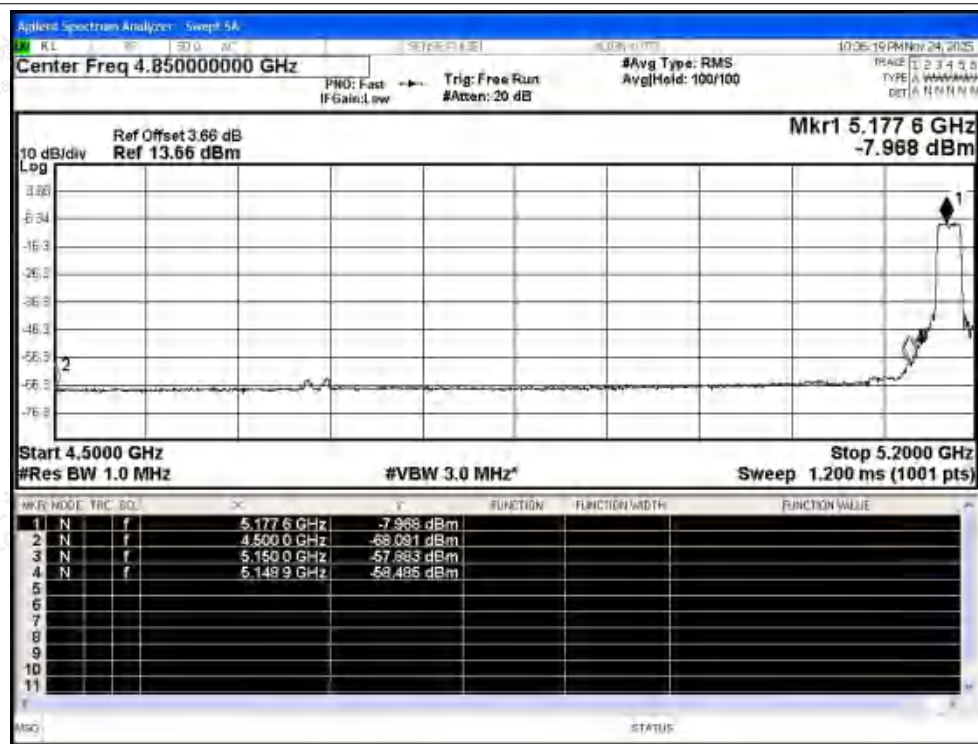

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant1 Peak

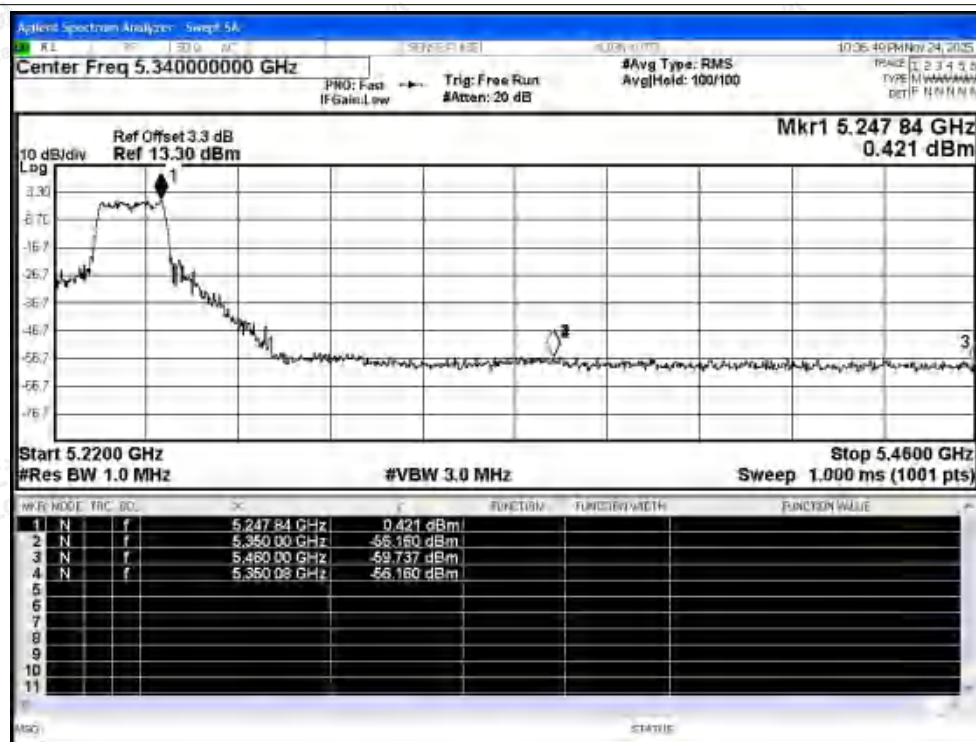


Restrict Band NVNT n20 5240MHz Ant1 Average

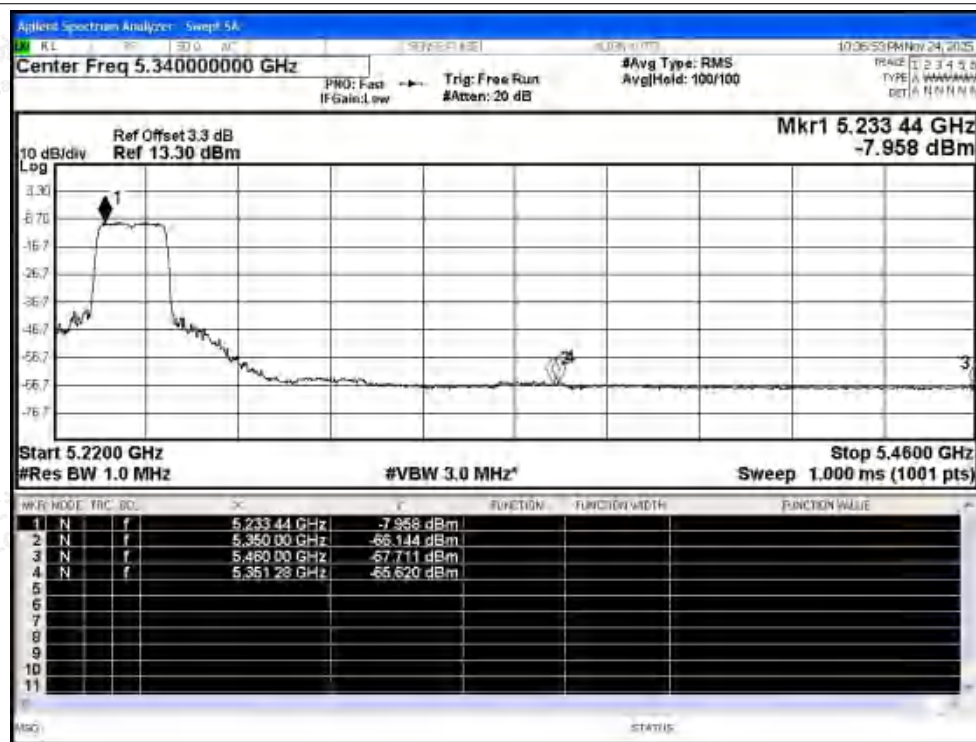




Restrict Band NVNT n40 5190MHz Ant1 Peak

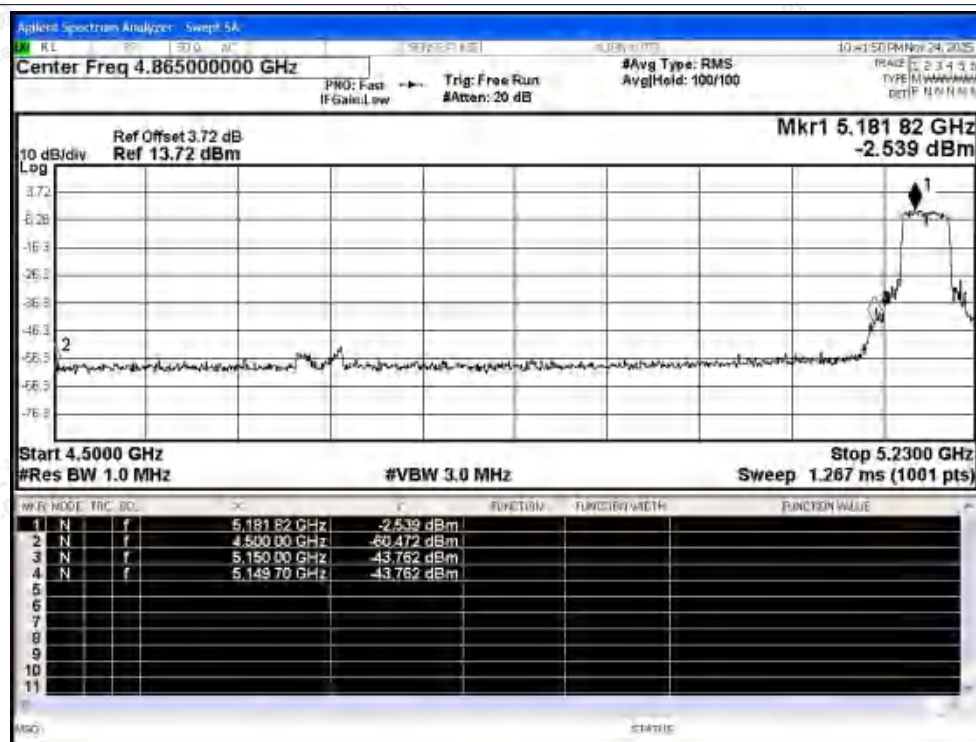

Restrict Band NVNT n40 5190MHz Ant1 Average

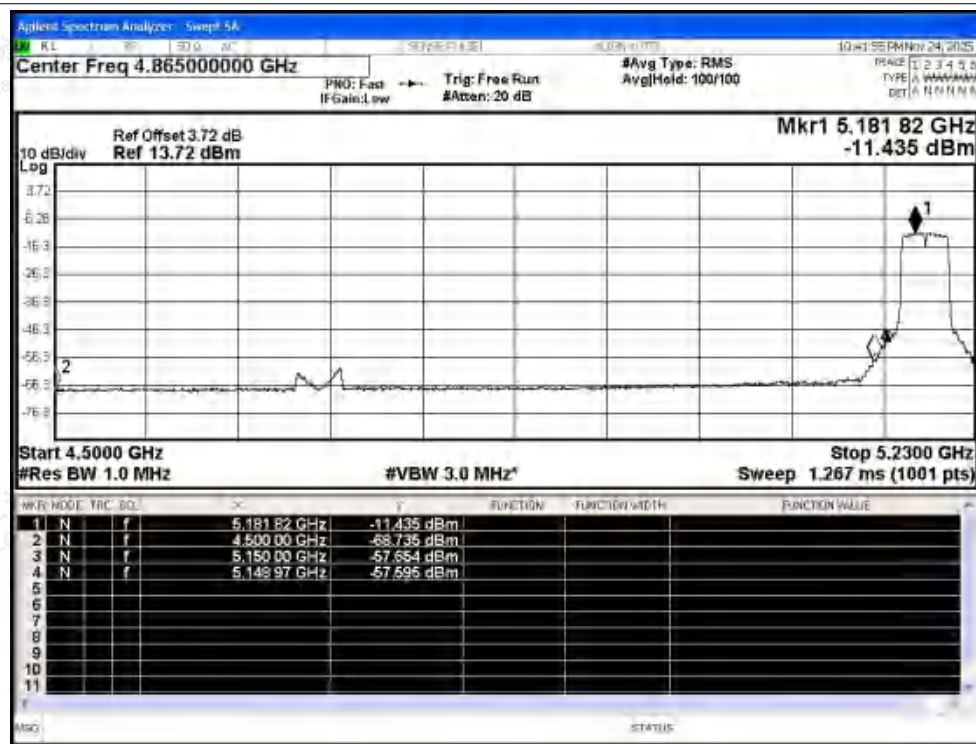

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant1 Peak

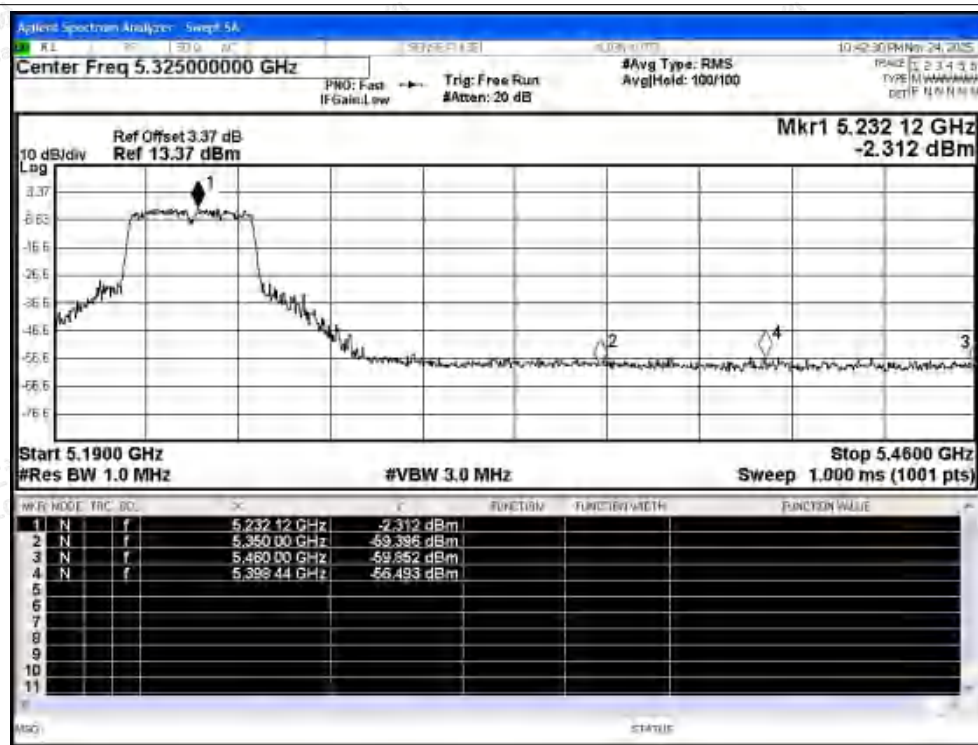

Restrict Band NVNT n40 5230MHz Ant1 Average

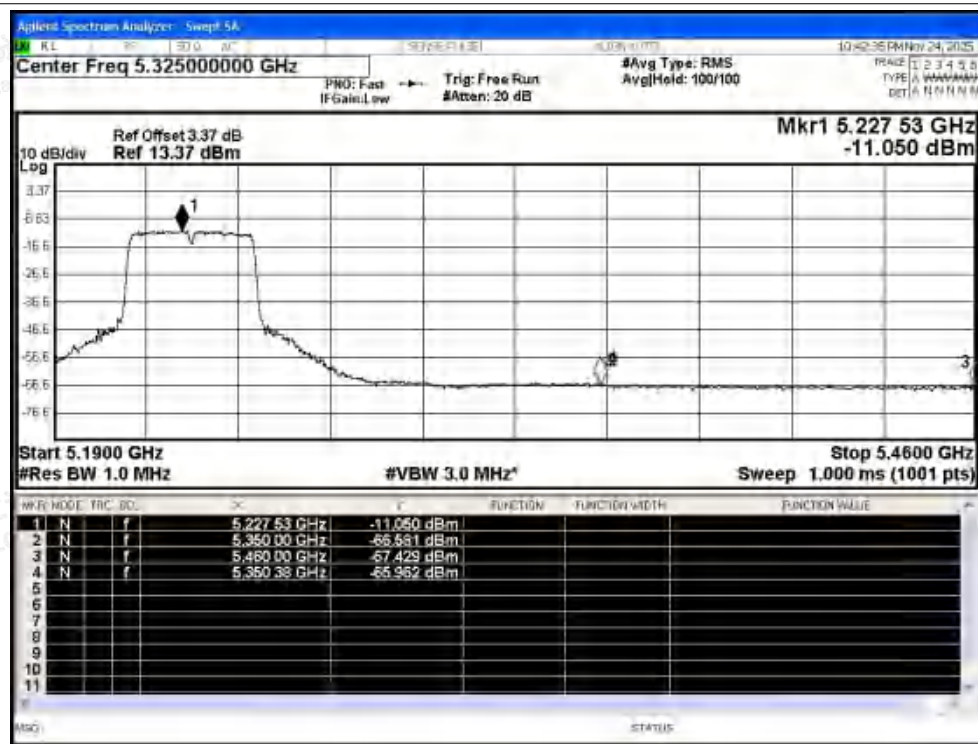

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Restrict Band NVNT ac20 5180MHz Ant1 Peak

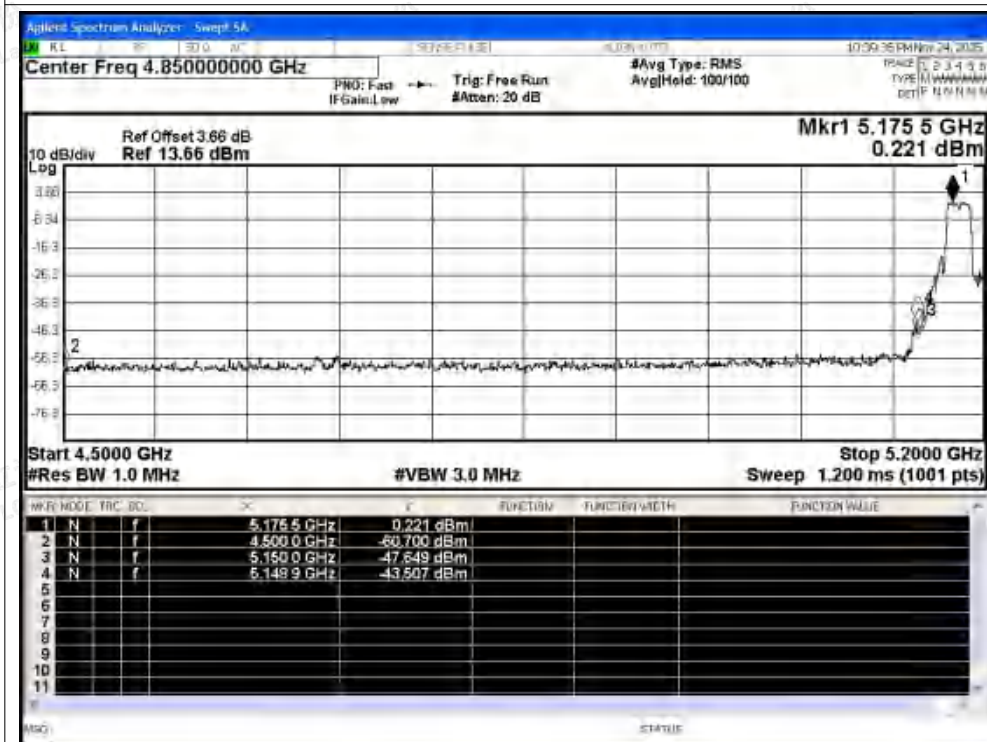


Restrict Band NVNT ac20 5180MHz Ant1 Average

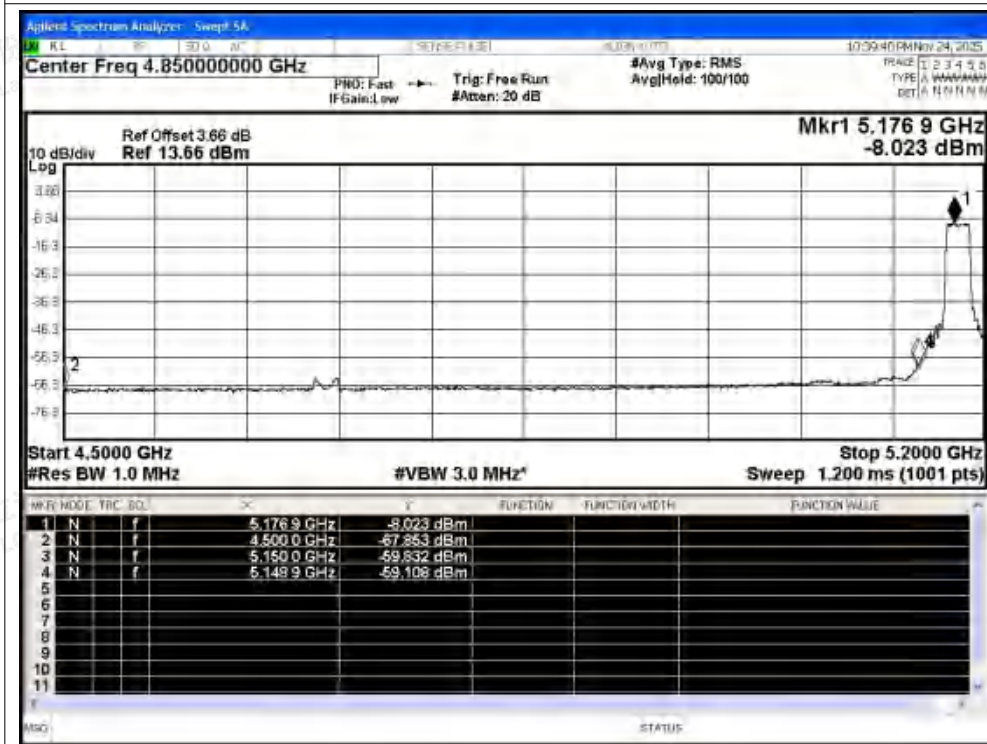




Restrict Band NVNT ac20 5240MHz Ant1 Peak

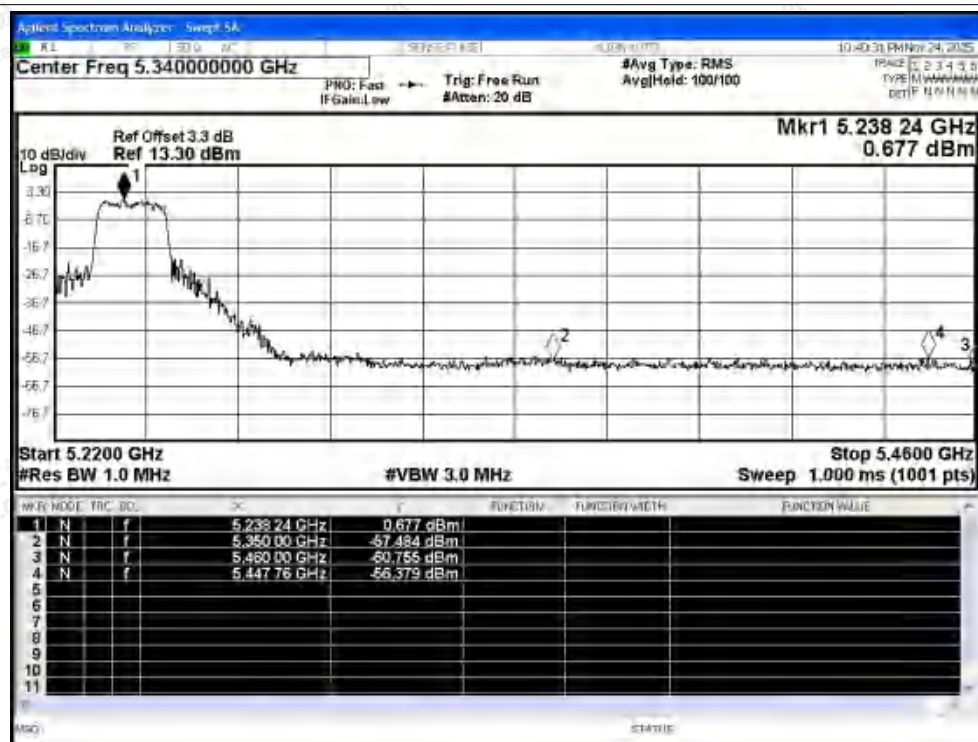

Restrict Band NVNT ac20 5240MHz Ant1 Average

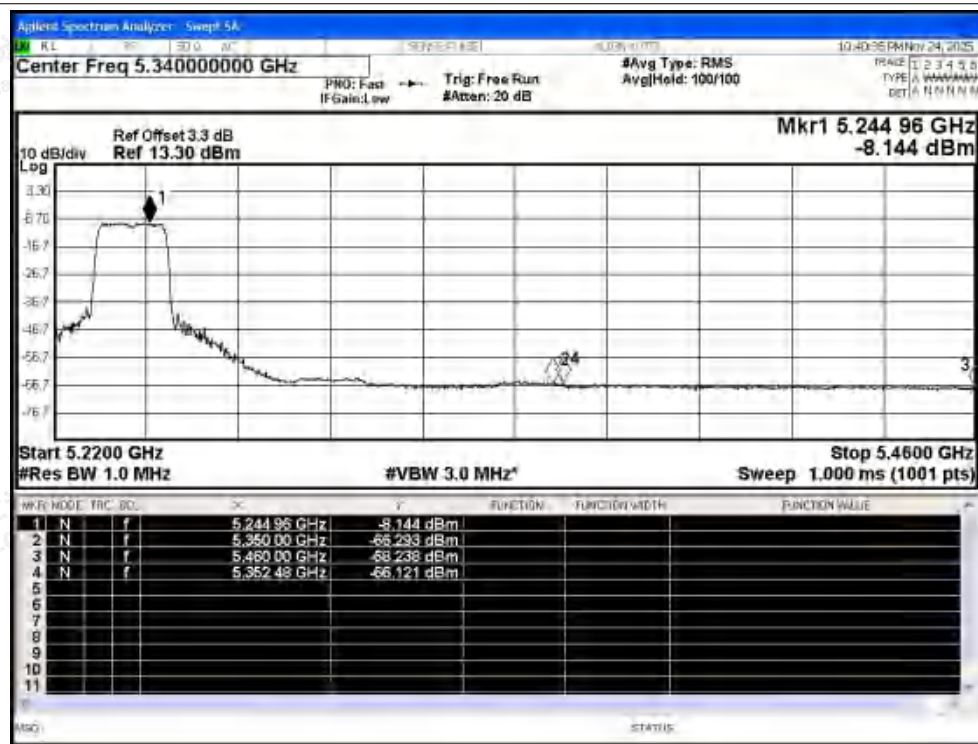

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

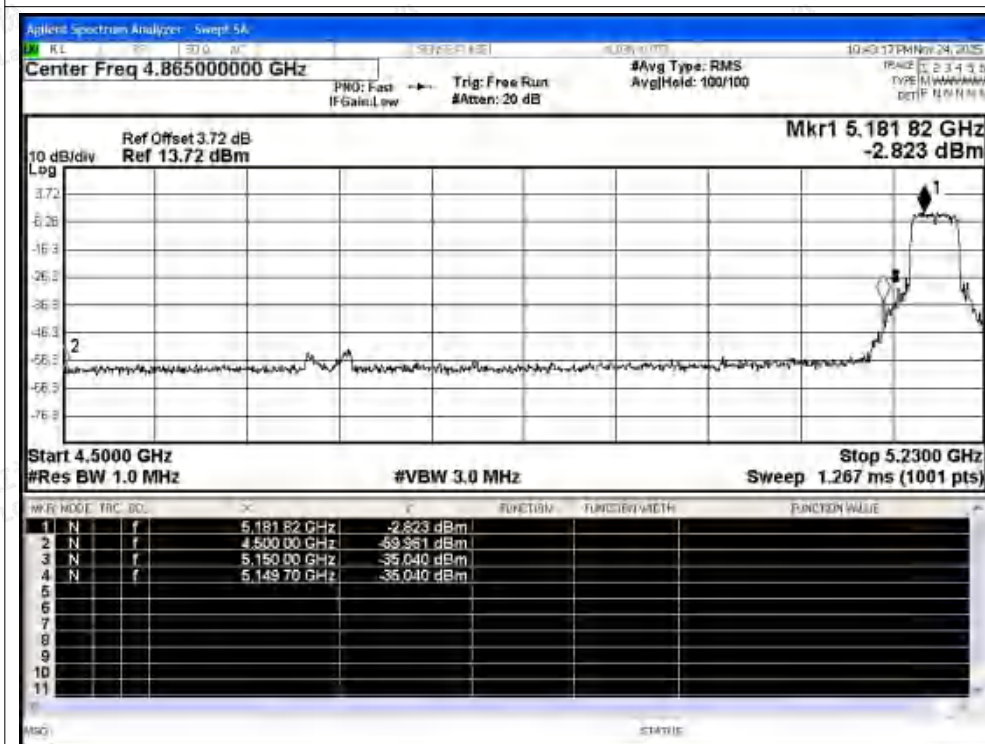

Restrict Band NVNT ac40 5190MHz Ant1 Average

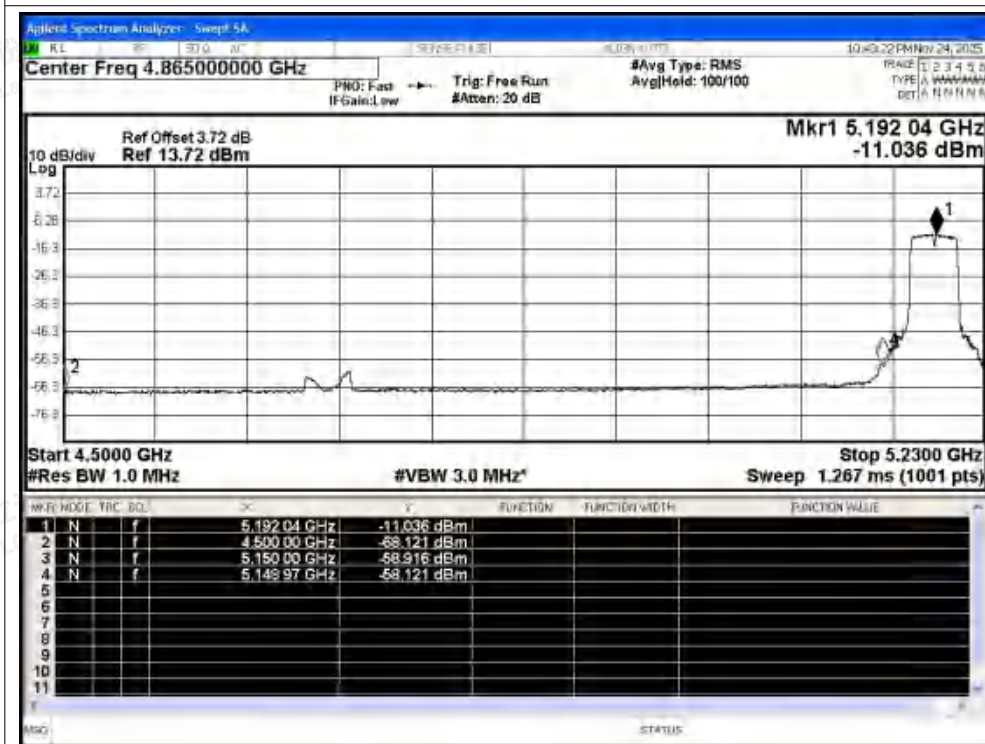

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant1 Peak

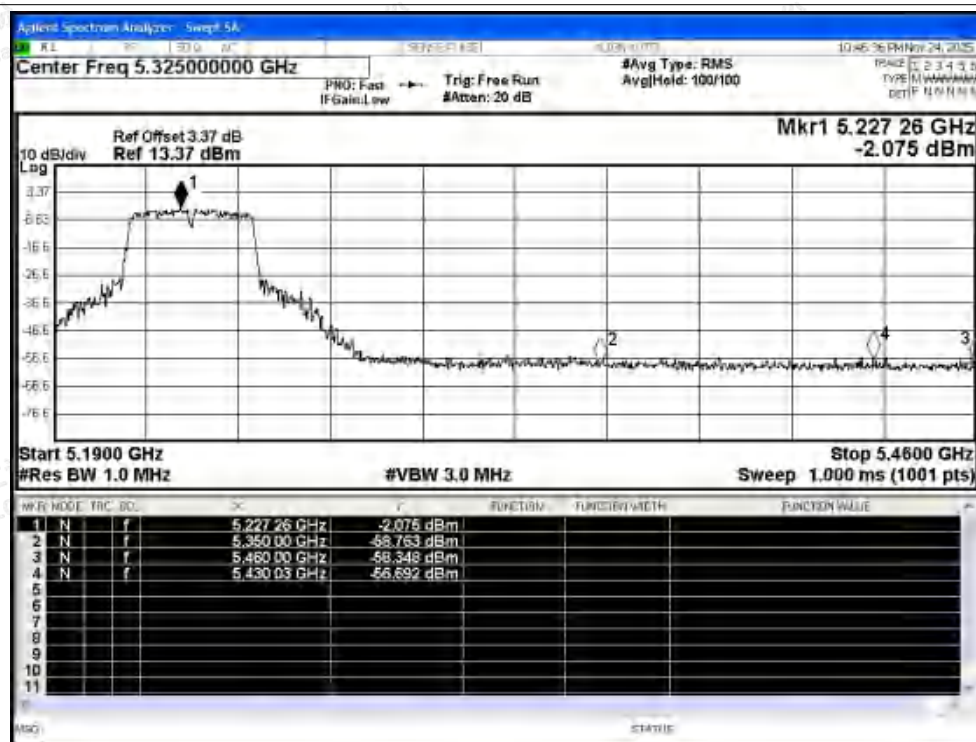

Restrict Band NVNT ac40 5230MHz Ant1 Average

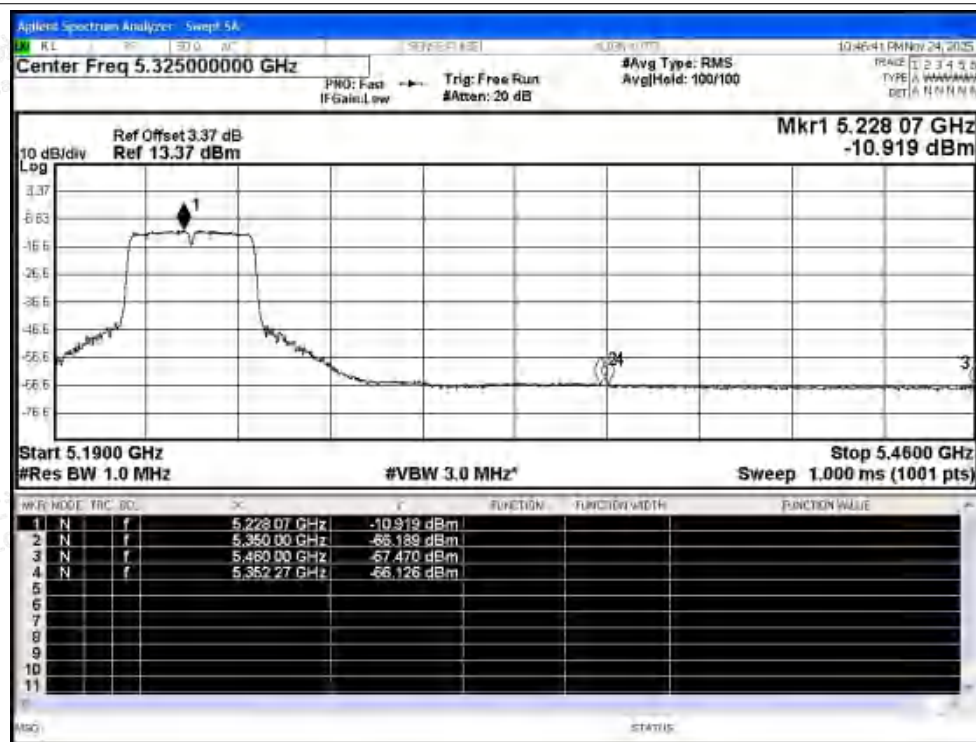

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

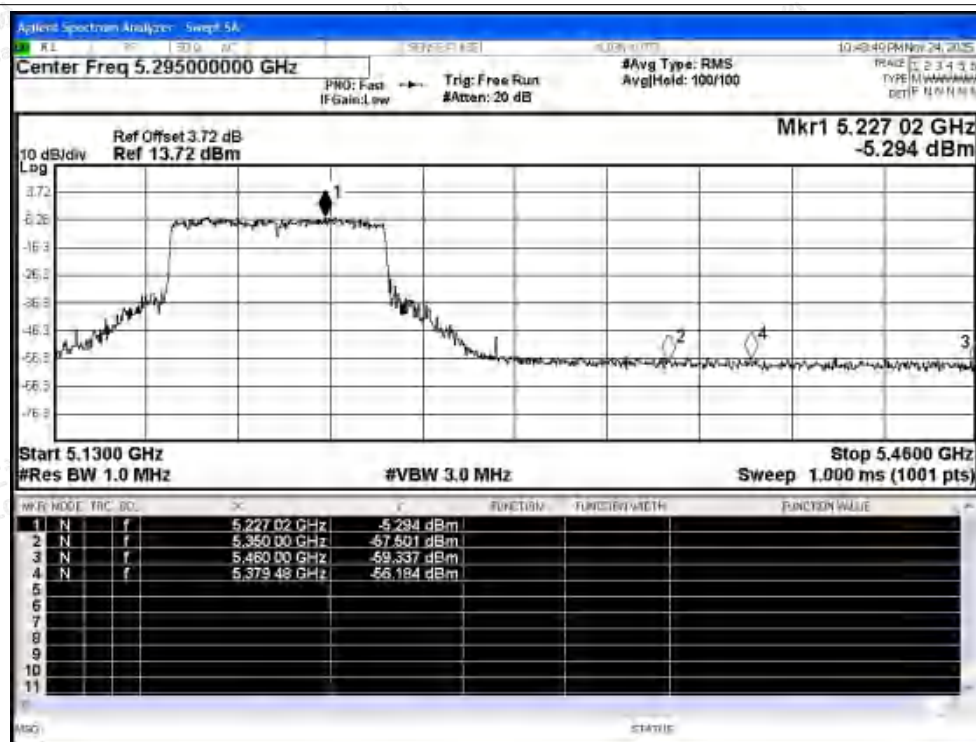

Restrict Band NVNT ac80 5210MHz Ant1 Average

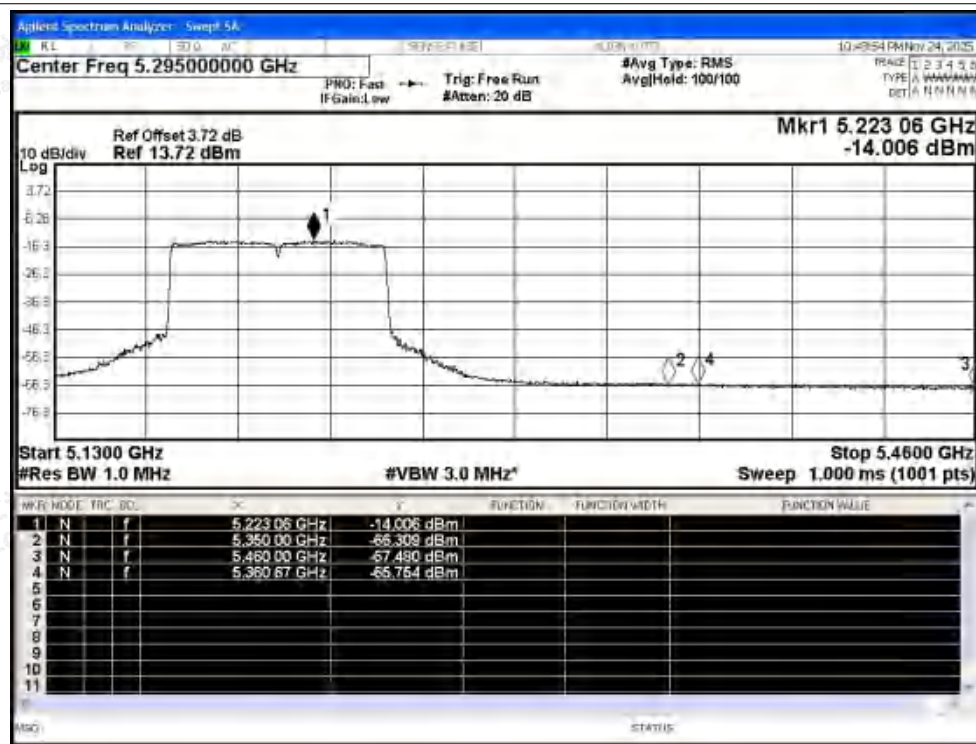

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak




Restrict Band NVNT ac80 5210MHz Ant1 Average

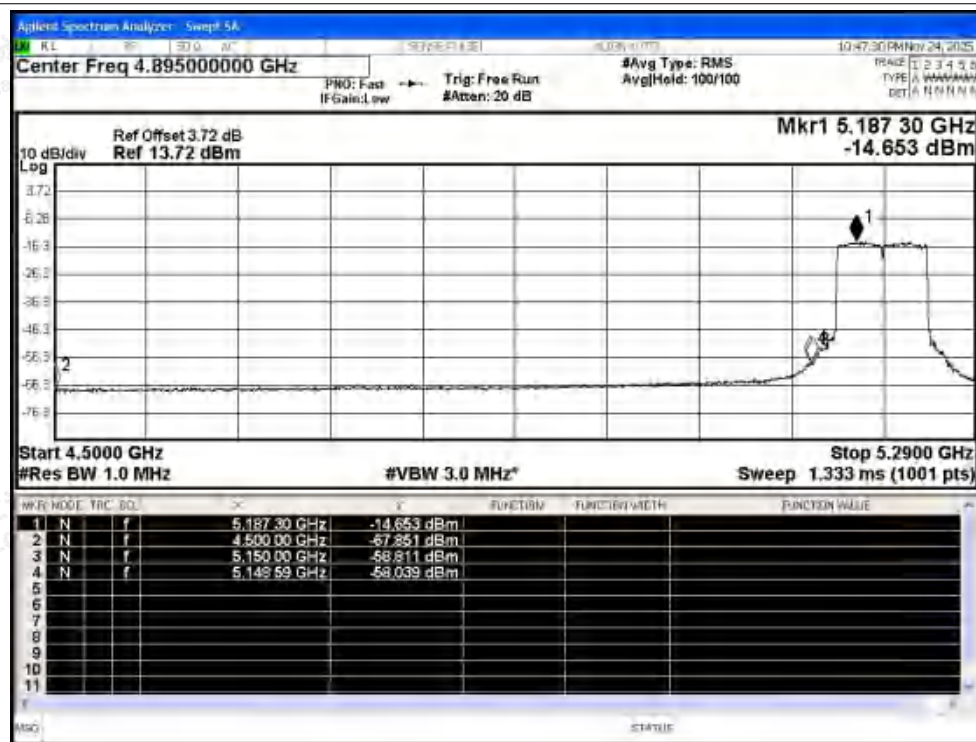




Restrict Band NVNT ax20 5180MHz Ant1 Peak

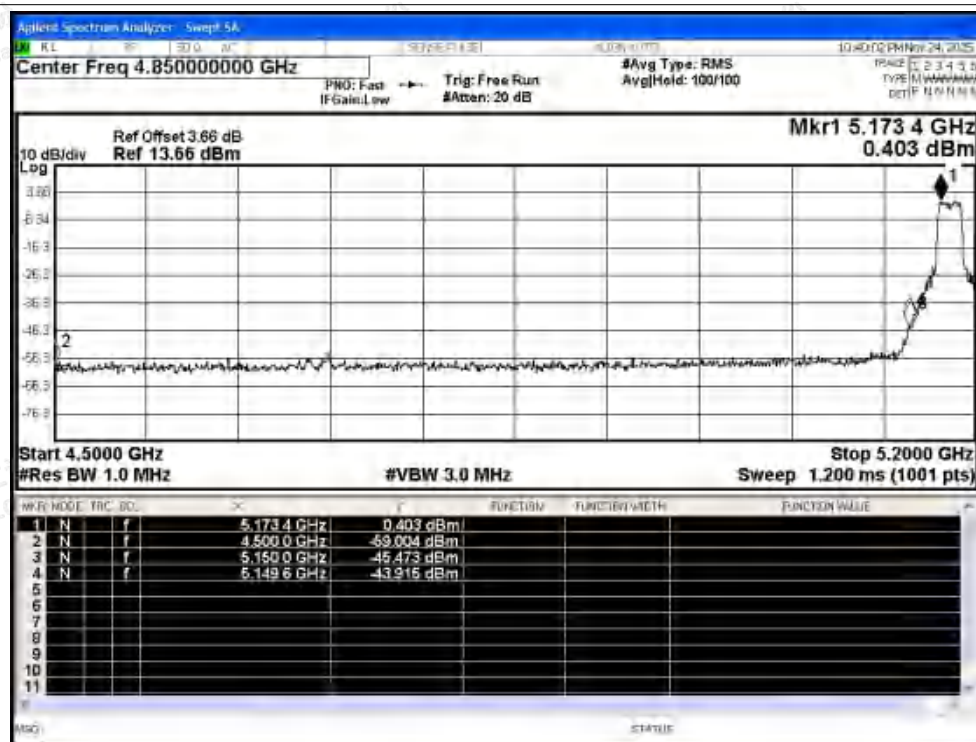


Restrict Band NVNT ax20 5180MHz Ant1 Average

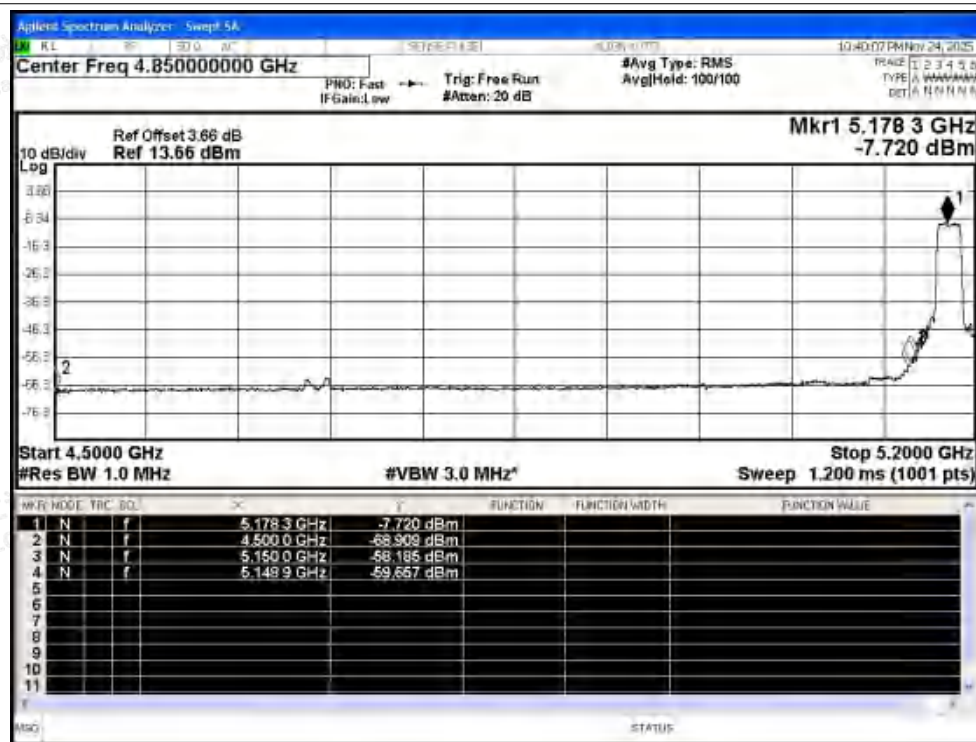




Restrict Band NVNT ax20 5240MHz Ant1 Peak

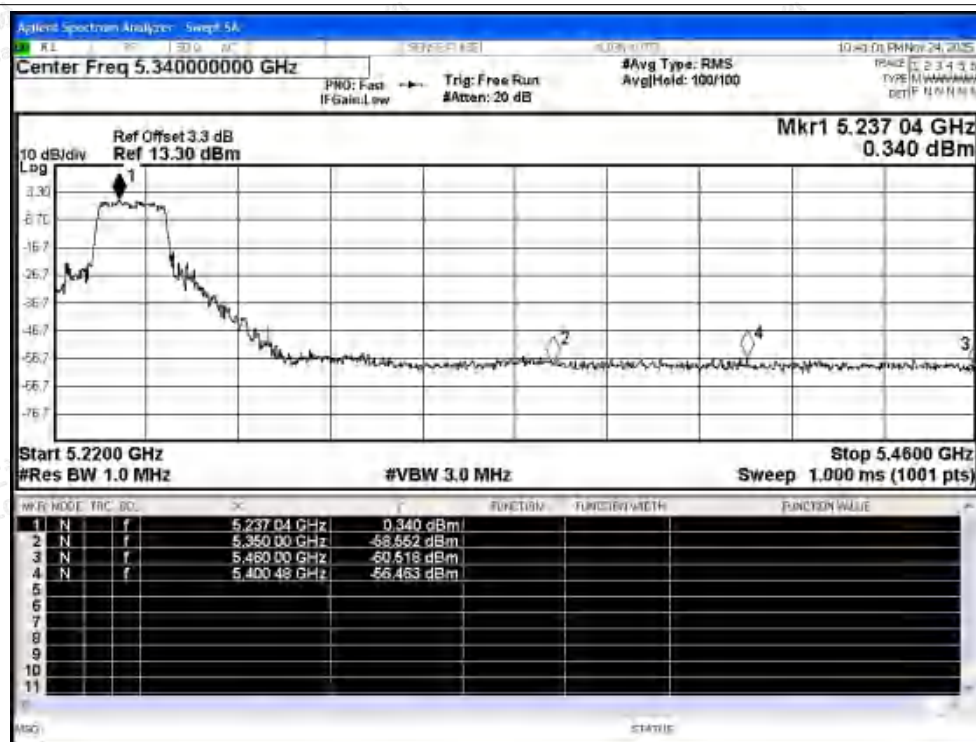


Restrict Band NVNT ax20 5240MHz Ant1 Average

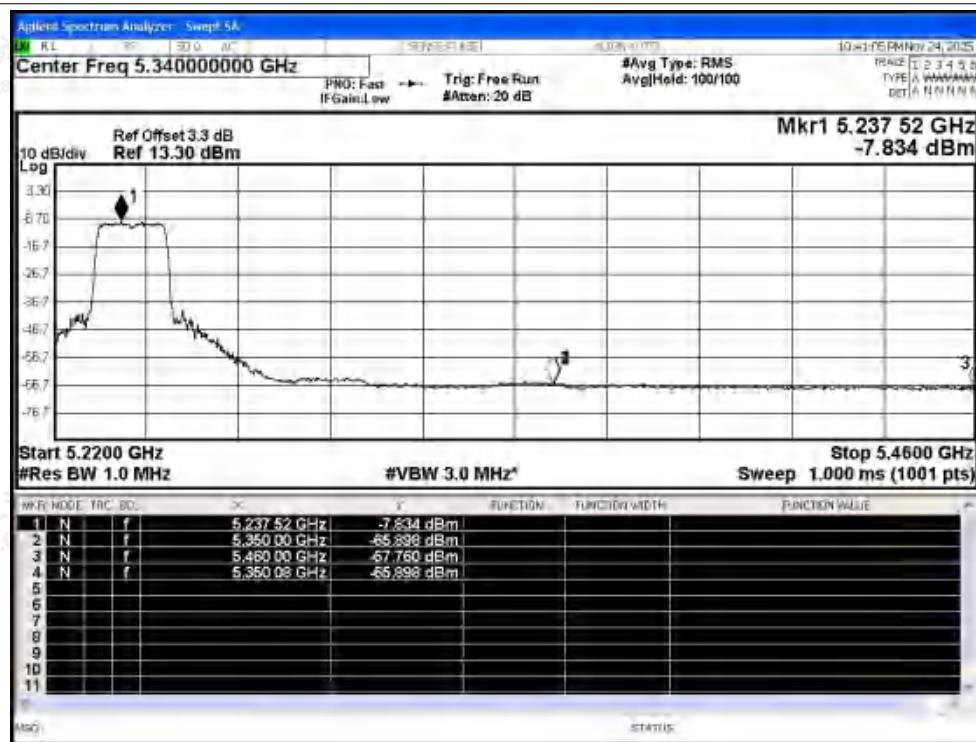




Restrict Band NVNT ax40 5190MHz Ant1 Peak

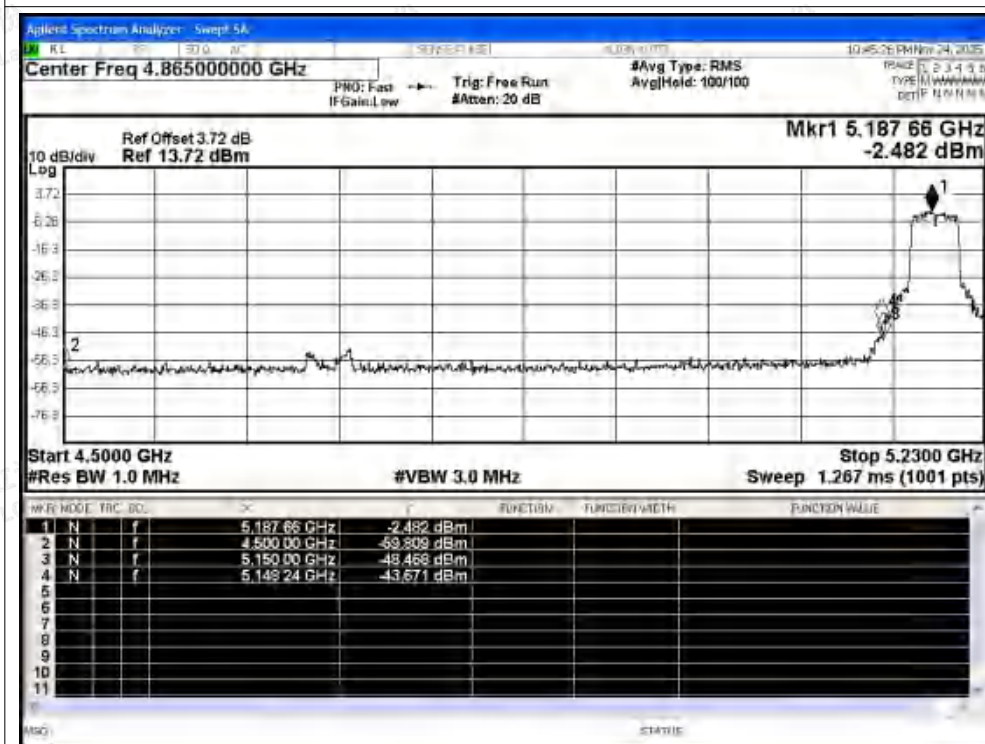


Restrict Band NVNT ax40 5190MHz Ant1 Average

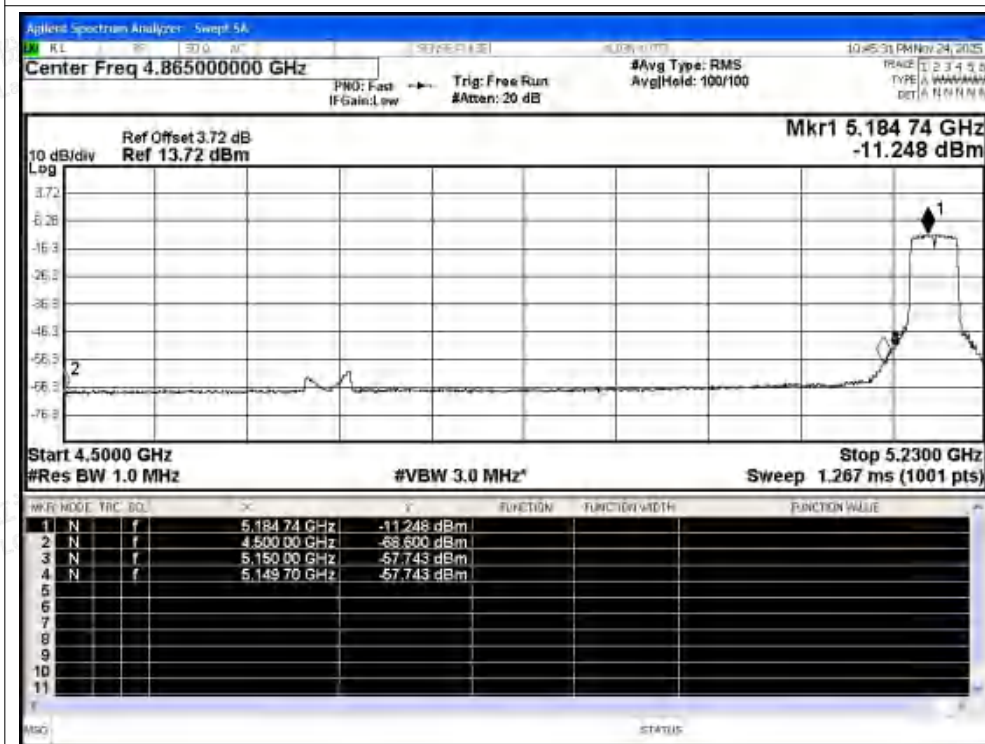




Restrict Band NVNT ax40 5230MHz Ant1 Peak

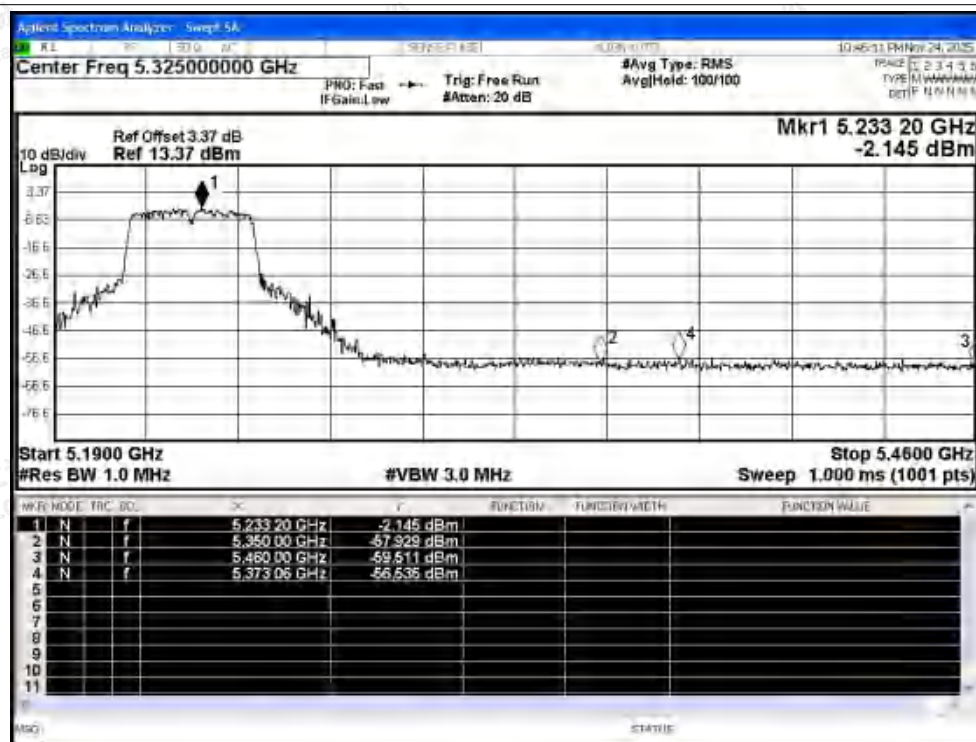

Restrict Band NVNT ax40 5230MHz Ant1 Average

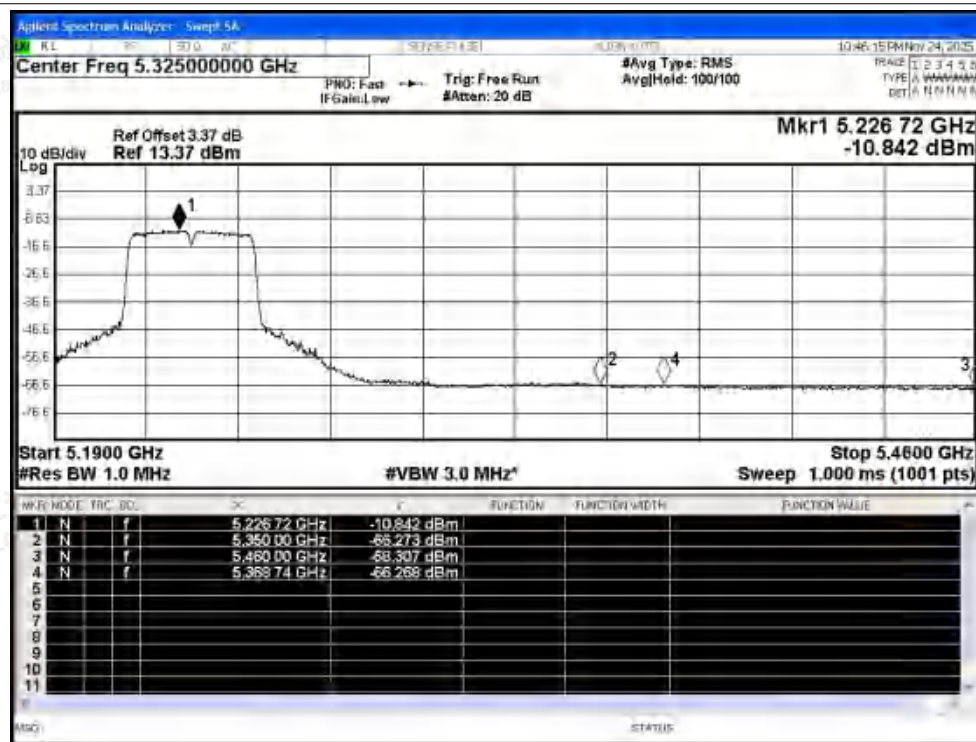

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

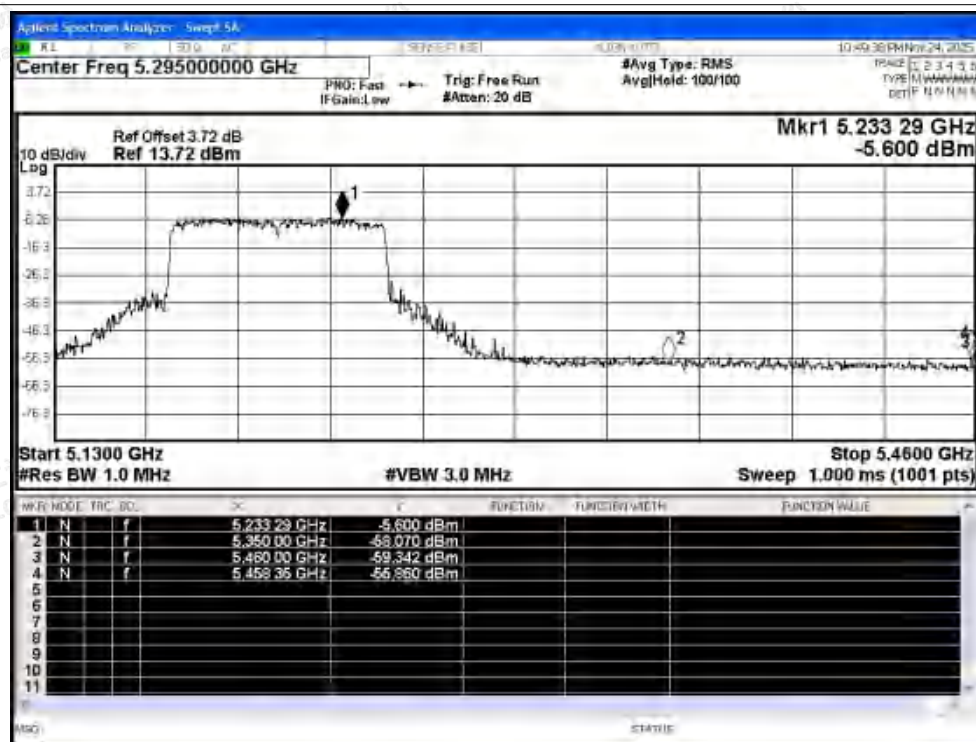


Restrict Band NVNT ax80 5210MHz Ant1 Average

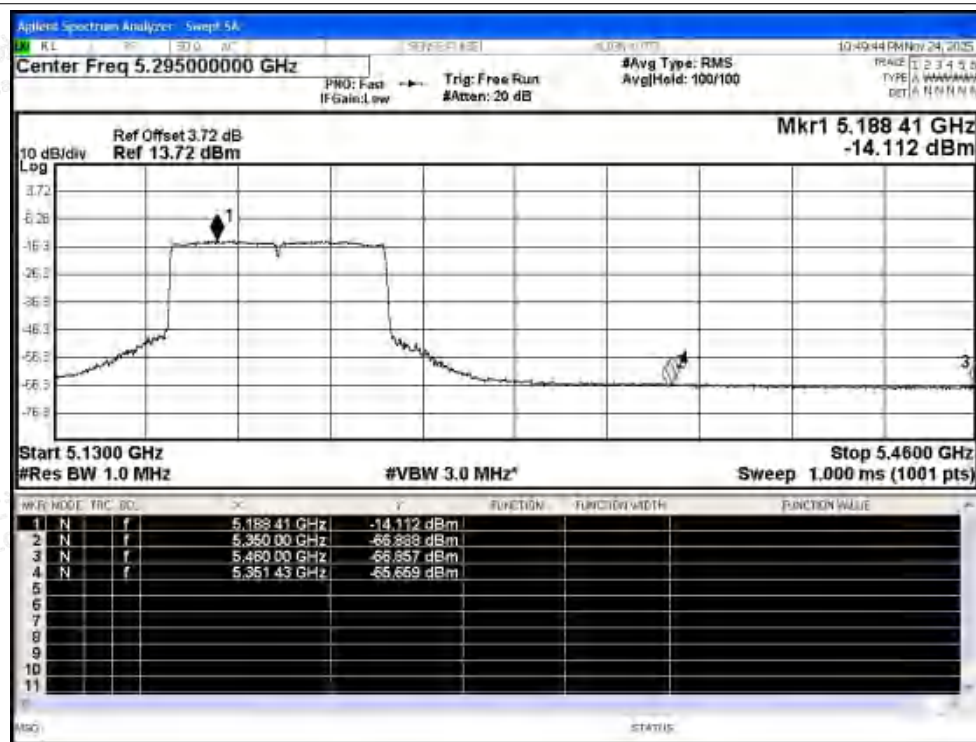




Restrict Band NVNT ax80 5210MHz Ant1 Peak

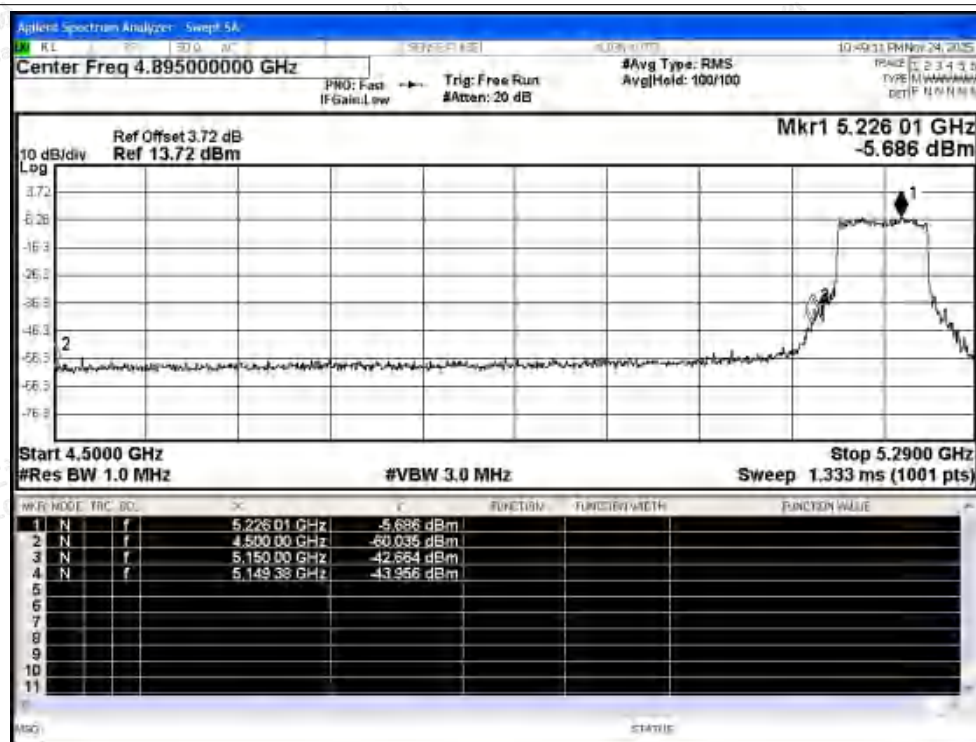


Restrict Band NVNT ax80 5210MHz Ant1 Average

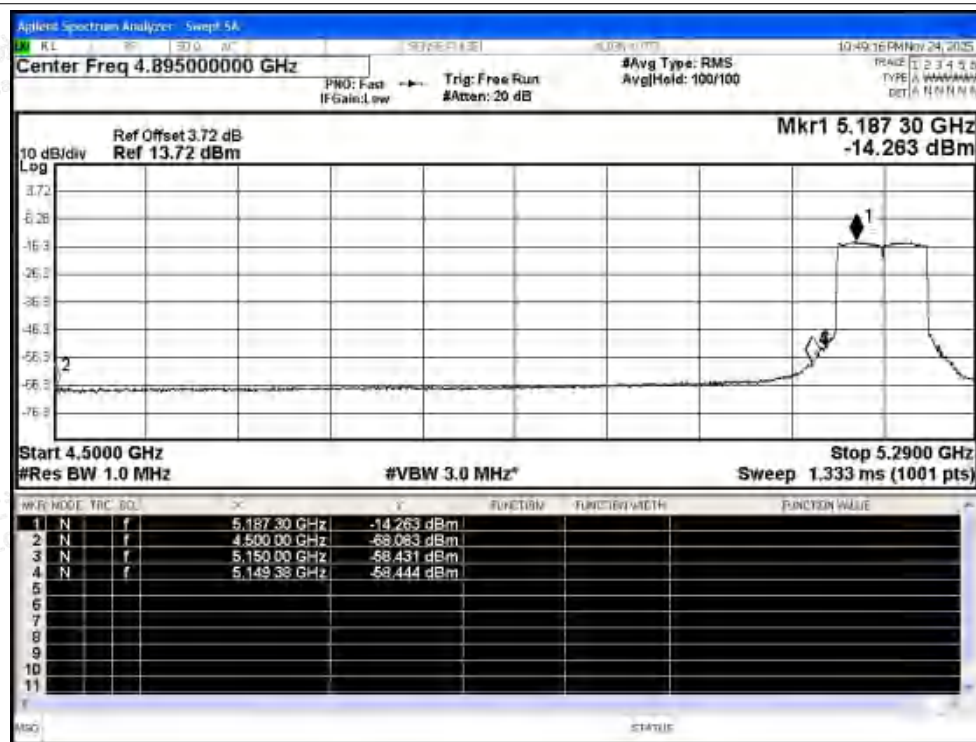




Restrict Band NVNT ac160 5250MHz Ant1 Peak

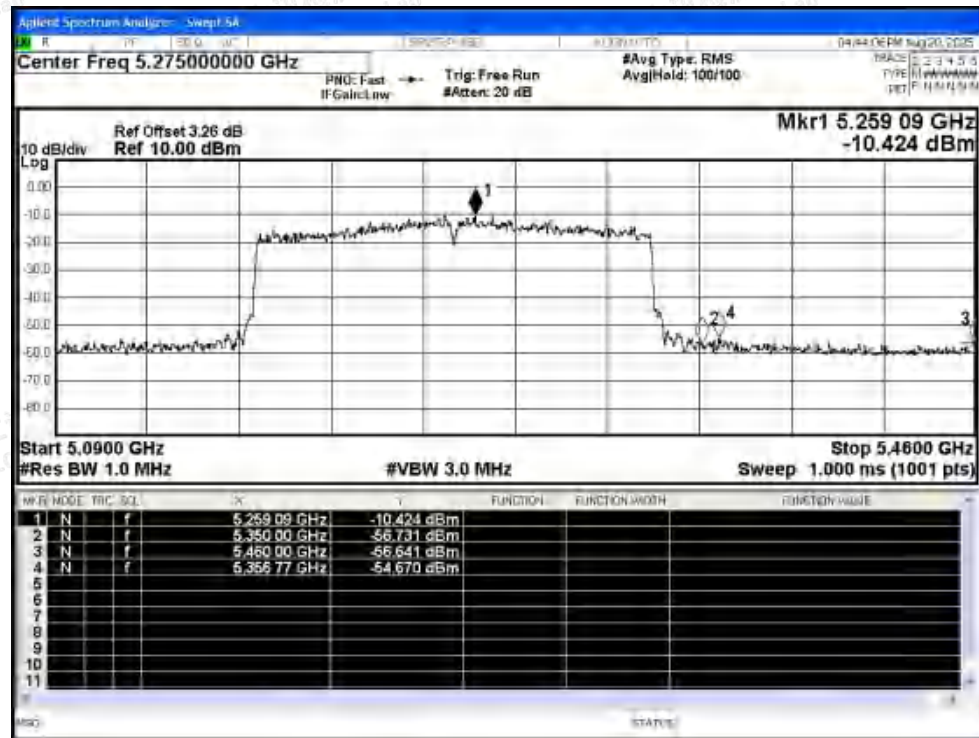

Restrict Band NVNT ac160 5250MHz Ant1 Average

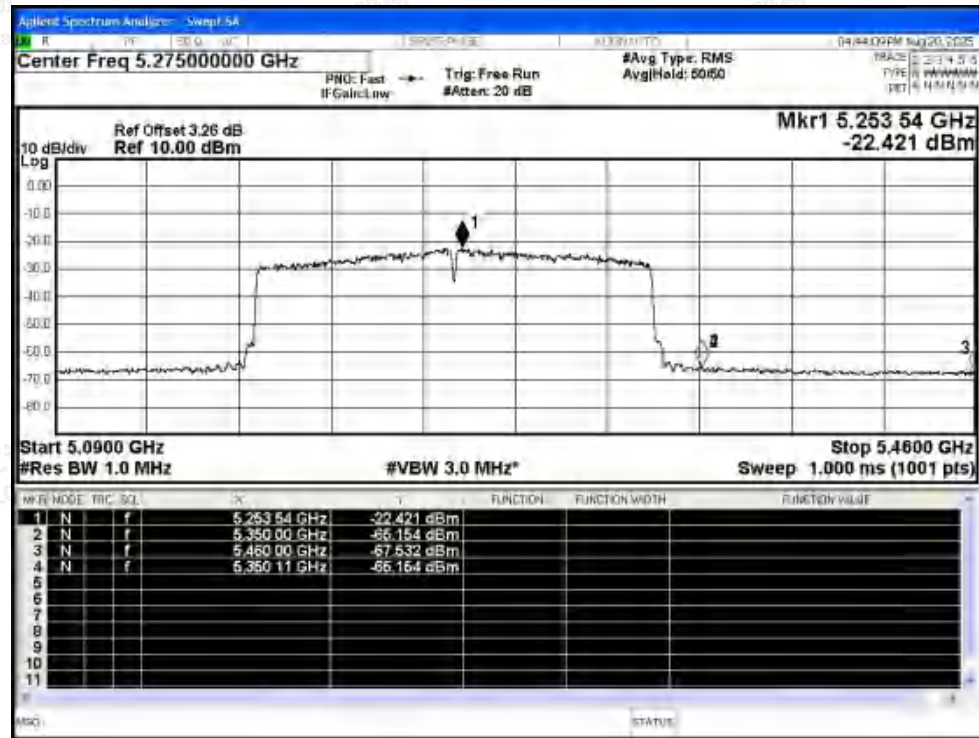


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant1 Peak

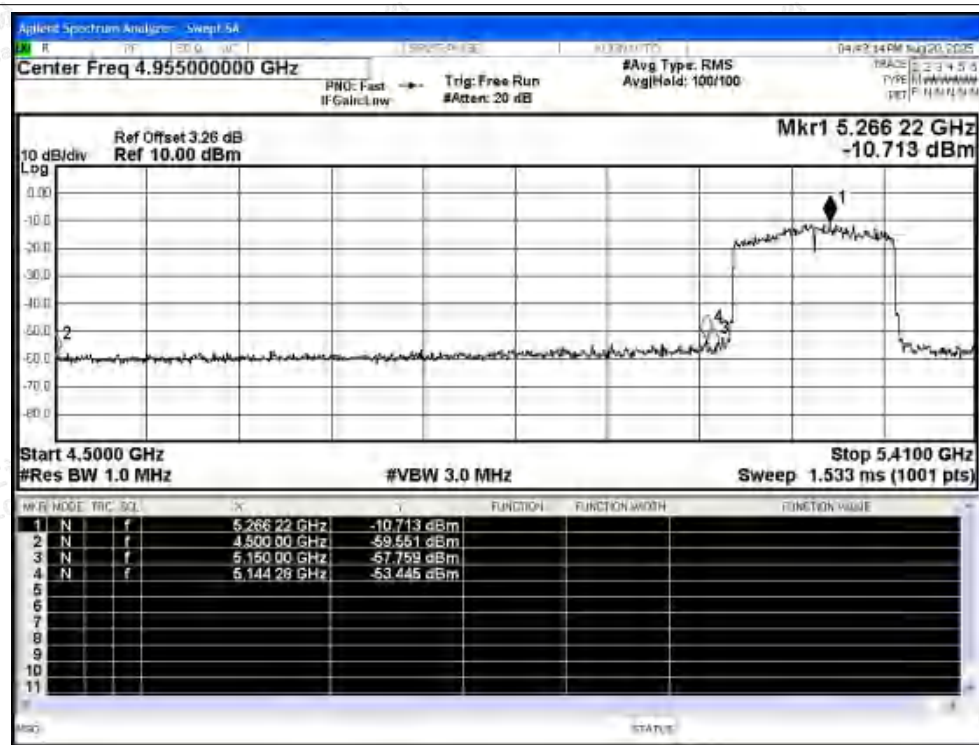

Restrict Band NVNT ac160 5250MHz Ant1 Average

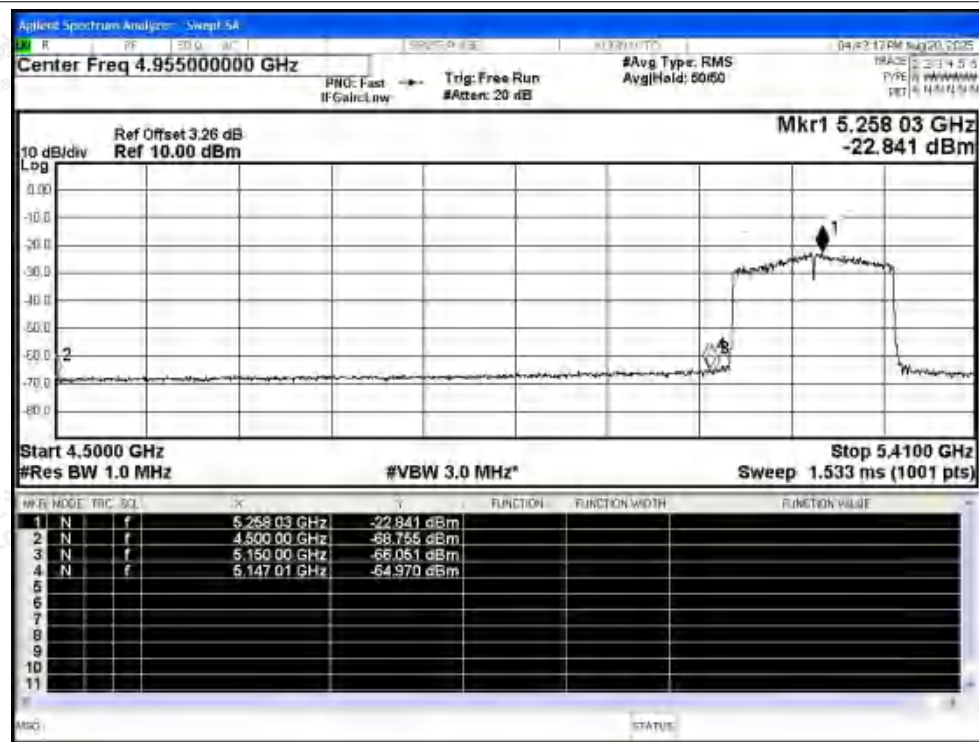

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant1 Peak

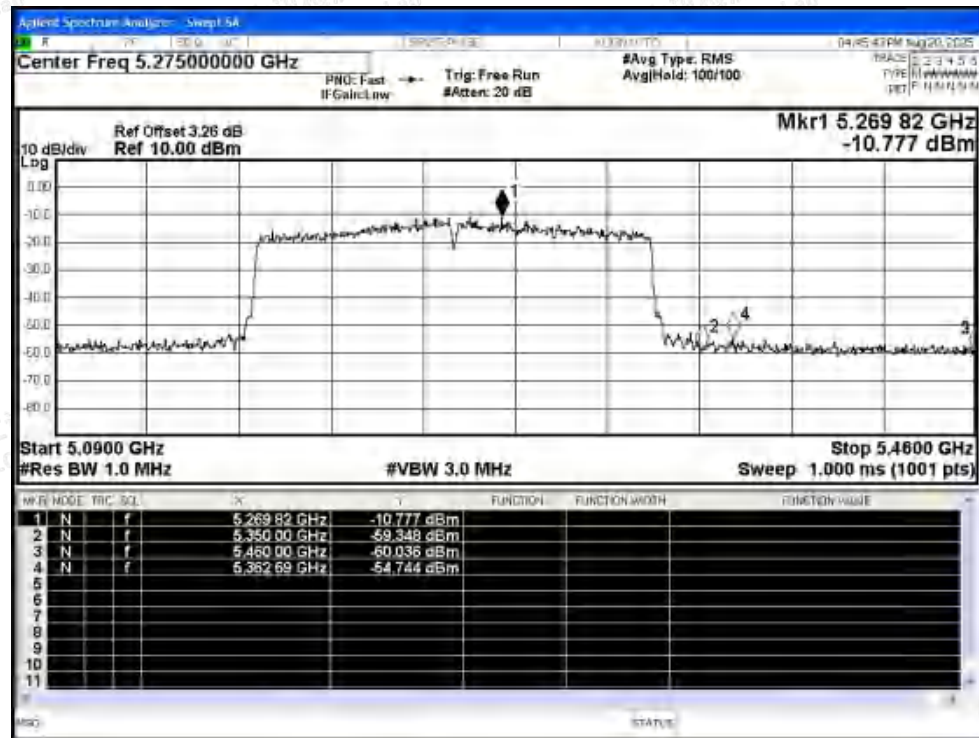

Restrict Band NVNT ax160 5250MHz Ant1 Average

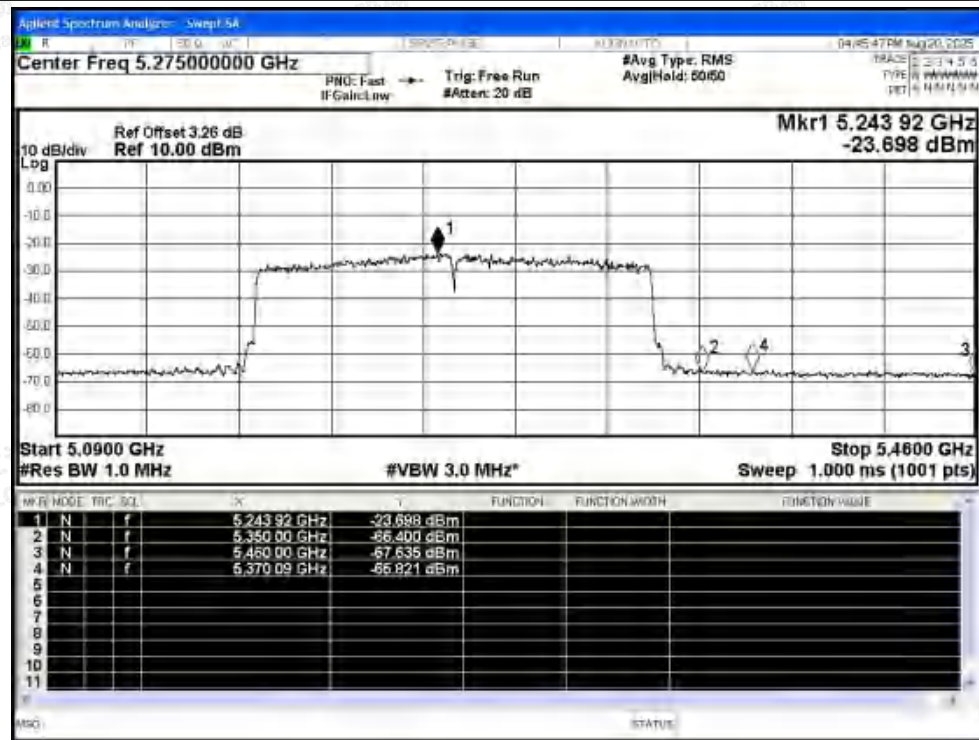

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant1 Peak

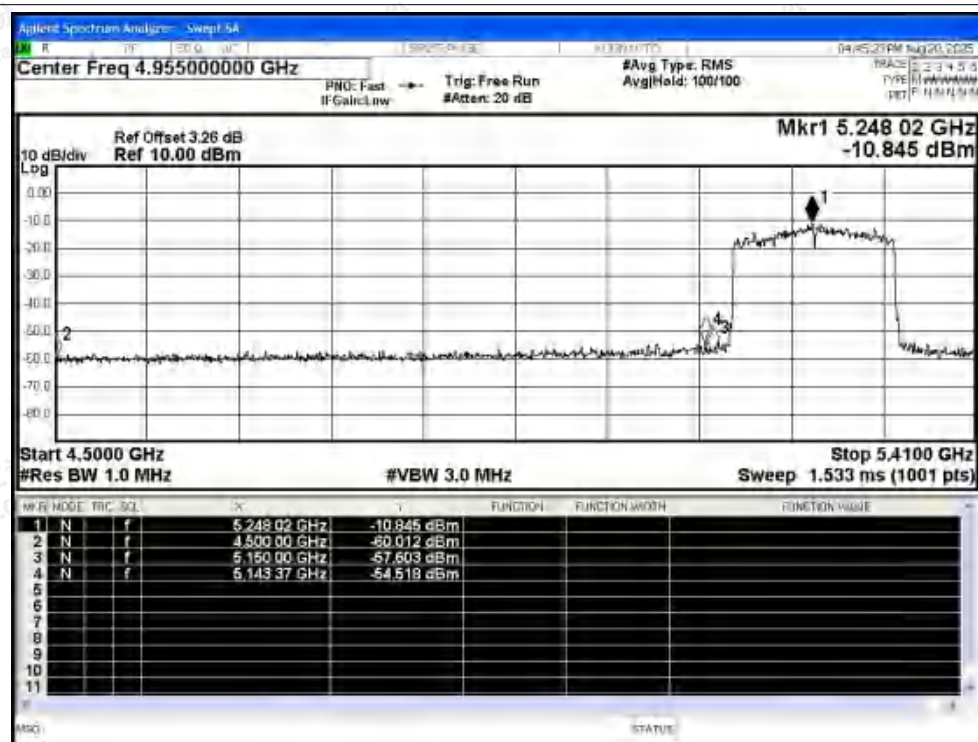

Restrict Band NVNT ax160 5250MHz Ant1 Average

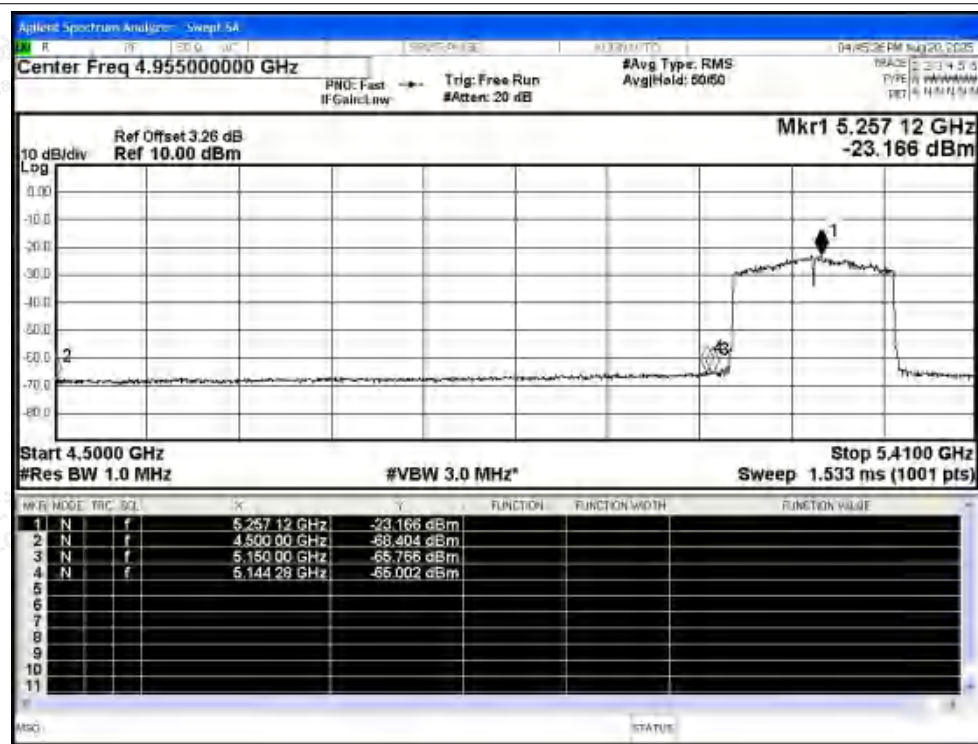


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-58.76	4.94	-	41.41	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-68.28	4.94	0.11	32	Average	54	Pass
NVNT	a	5180	Ant2	5148.9	-45.59	4.94	-	54.58	Peak	68.2	Pass
NVNT	a	5180	Ant2	5149.6	-58.8	4.94	0.11	41.48	Average	54	Pass
NVNT	a	5180	Ant2	5150	-46.02	4.94	-	54.15	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-57.59	4.94	0.11	42.69	Average	54	Pass
NVNT	a	5240	Ant2	5350	-57.13	4.94	-	43.04	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-64.82	4.94	0.11	35.46	Average	54	Pass
NVNT	a	5240	Ant2	5352	-55.71	4.94	-	44.46	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350.32	-64.61	4.94	0.11	35.67	Average	54	Pass
NVNT	a	5240	Ant2	5460	-58.7	4.94	-	41.47	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-67.66	4.94	0.11	32.62	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-49.72	4.94	-	50.45	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-58.02	4.94	0.11	42.26	Average	54	Pass
NVNT	n20	5180	Ant2	5149.6	-43.74	4.94	-	56.43	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5149.6	-55.17	4.94	0.11	45.11	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-43.93	4.94	-	56.24	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-54.39	4.94	0.11	45.89	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-58.16	4.94	-	42.01	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-66.47	4.94	0.11	33.81	Average	54	Pass
NVNT	n20	5240	Ant2	5369.52	-55.93	4.94	-	44.24	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5351.52	-65.83	4.94	0.11	34.45	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-58.69	4.94	-	41.48	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-67.72	4.94	0.11	32.56	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-59.75	4.94	-	40.42	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-68.41	4.94	0.22	31.98	Average	54	Pass
NVNT	n40	5190	Ant2	5148.97	-43.04	4.94	-	57.13	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5148.24	-58.71	4.94	0.22	41.68	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-47.99	4.94	-	52.18	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-58.96	4.94	0.22	41.43	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-57.86	4.94	-	42.31	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-67.06	4.94	0.23	33.34	Average	54	Pass
NVNT	n40	5230	Ant2	5369.01	-56.46	4.94	-	43.71	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5364.69	-66.24	4.94	0.23	34.16	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-58.34	4.94	-	41.83	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-67.47	4.94	0.11	32.81	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-59.72	4.94	-	40.45	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	4500	-67.9	4.94	0.11	32.38	Average	54	Pass
NVNT	ac20	5180	Ant2	5145.4	-45.24	4.94	-	54.93	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5149.6	-59.16	4.94	0.11	41.12	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-47.61	4.94	-	52.56	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-58.62	4.94	0.11	41.66	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-57.42	4.94	-	42.75	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-65.86	4.94	0.11	34.42	Average	54	Pass
NVNT	ac20	5240	Ant2	5427.84	-56.61	4.94	-	43.56	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350.08	-65.86	4.94	0.11	34.42	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-58.74	4.94	-	41.43	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-67.89	4.94	0.11	32.39	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-60.36	4.94	-	39.81	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-68.81	4.94	0.22	31.58	Average	54	Pass
NVNT	ac40	5190	Ant2	5148.97	-42.84	4.94	-	57.33	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5148.97	-57.53	4.94	0.22	42.86	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-45.91	4.94	-	54.26	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-57.65	4.94	0.22	42.74	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-58.56	4.94	-	41.61	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-66.32	4.94	0.23	34.08	Average	54	Pass
NVNT	ac40	5230	Ant2	5400.87	-56.81	4.94	-	43.36	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350.92	-65.96	4.94	0.23	34.44	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-59.27	4.94	-	40.9	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-67.15	4.94	0.23	33.25	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-57.95	4.94	-	42.22	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-66.46	4.94	0.43	34.14	Average	54	Pass
NVNT	ac80	5210	Ant2	5385.42	-55.97	4.94	-	44.2	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5402.25	-65.68	4.94	0.43	34.92	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-59.62	4.94	-	40.55	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-67.49	4.94	0.43	33.11	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-59.19	4.94	-	40.98	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-67.62	4.94	0.43	32.98	Average	54	Pass
NVNT	ac80	5210	Ant2	5147.8	-44.49	4.94	-	55.68	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5147.8	-57.96	4.94	0.43	42.64	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-46.4	4.94	-	53.77	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-57.44	4.94	0.43	43.16	Average	54	Pass
NVNT	ax20	5180	Ant2	4500	-60.19	4.94	-	39.98	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-68.12	4.94	0.11	32.16	Average	54	Pass
NVNT	ax20	5180	Ant2	5149.6	-40.26	4.94	-	59.91	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5149.6	-60.36	4.94	0.11	39.92	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-40.55	4.94	-	59.62	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5150	-58.28	4.94	0.11	42	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant2	5350	-57.71	4.94	-	42.46	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5350	-66.06	4.94	0.12	34.23	Average	54	Pass
NVNT	ax20	5240	Ant2	5359.68	-56.48	4.94	-	43.69	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5351.28	-65.72	4.94	0.12	34.57	Average	54	Pass
NVNT	ax20	5240	Ant2	5460	-58.03	4.94	-	42.14	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5460	-67.56	4.94	0.12	32.73	Average	54	Pass
NVNT	ax40	5190	Ant2	4500	-59.46	4.94	-	40.71	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-67.87	4.94	0.22	32.52	Average	54	Pass
NVNT	ax40	5190	Ant2	5149.7	-43.77	4.94	-	56.4	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5149.7	-57.64	4.94	0.22	42.75	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-43.77	4.94	-	56.4	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-57.64	4.94	0.22	42.75	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-58.23	4.94	-	41.94	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-65.94	4.94	0.22	34.45	Average	54	Pass
NVNT	ax40	5230	Ant2	5442.18	-55.89	4.94	-	44.28	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350.11	-65.94	4.94	0.22	34.45	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-59.39	4.94	-	40.78	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-67.63	4.94	0.22	32.76	Average	54	Pass
NVNT	ax80	5210	Ant2	5350	-57.78	4.94	-	42.39	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350	-66.32	4.94	0.43	34.28	Average	54	Pass
NVNT	ax80	5210	Ant2	5394.33	-55.77	4.94	-	44.4	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5356.38	-65.83	4.94	0.43	34.77	Average	54	Pass
NVNT	ax80	5210	Ant2	5460	-59.51	4.94	-	40.66	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5460	-67.62	4.94	0.43	32.98	Average	54	Pass
NVNT	ax80	5210	Ant2	4500	-60.04	4.94	-	40.13	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-68.42	4.94	0.43	32.18	Average	54	Pass
NVNT	ax80	5210	Ant2	5141.48	-42.02	4.94	-	58.15	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5149.38	-58.54	4.94	0.43	42.06	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-44.03	4.94	-	56.14	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-58.32	4.94	0.43	42.28	Average	54	Pass

NVNT	ac160	5250	Ant2	5350	-47.79	4.94	-	52.38	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5350	-67.04	4.94	2.81	35.94	Average	54	Pass
NVNT	ac160	5250	Ant2	5350.11	-47.79	4.94	-	52.38	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5392.66	-65.83	4.94	2.81	37.15	Average	54	Pass
NVNT	ac160	5250	Ant2	5460	-59.94	4.94	-	40.23	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5460	-67.03	4.94	2.81	35.95	Average	54	Pass
NVNT	ac160	5250	Ant2	4500	-59.81	4.94	-	40.36	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	4500	-68.58	4.94	2.81	34.4	Average	54	Pass
NVNT	ac160	5250	Ant2	5119.71	-53.7	4.94	-	46.47	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5146.1	-65.28	4.94	2.81	37.7	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac160	5250	Ant2	5150	-56.91	4.94	-	43.26	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5150	-66.24	4.94	2.81	36.74	Average	54	Pass
NVNT	ax160	5250	Ant2	5350	-58.25	4.94	-	41.92	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5350	-66.91	4.94	2.81	36.07	Average	54	Pass
NVNT	ax160	5250	Ant2	5358.25	-55.01	4.94	-	45.16	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5353.81	-65.55	4.94	2.81	37.43	Average	54	Pass
NVNT	ax160	5250	Ant2	5460	-58.61	4.94	-	41.56	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5460	-67.47	4.94	2.81	35.51	Average	54	Pass
NVNT	ax160	5250	Ant2	4500	-60.27	4.94	-	39.9	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	4500	-68.95	4.94	2.81	34.03	Average	54	Pass
NVNT	ax160	5250	Ant2	5146.1	-54.66	4.94	-	45.51	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5137.91	-65.63	4.94	2.81	37.35	Average	54	Pass
NVNT	ax160	5250	Ant2	5150	-58.01	4.94	-	42.16	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5150	-66.5	4.94	2.81	36.48	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

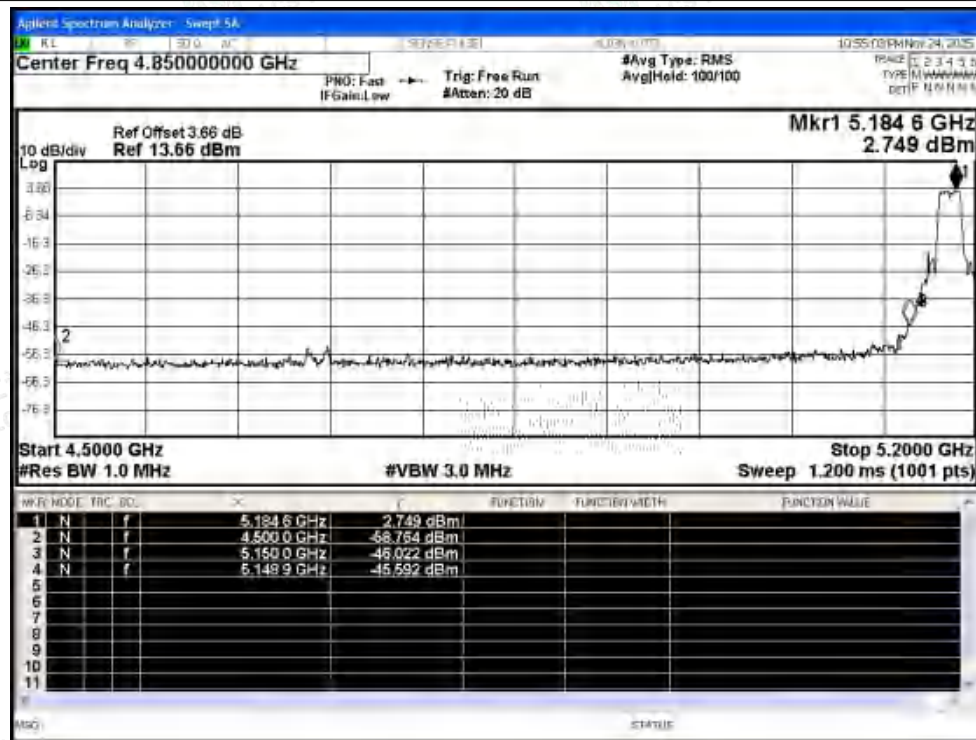


Restrict Band NVNT a 5180MHz Ant2 Average

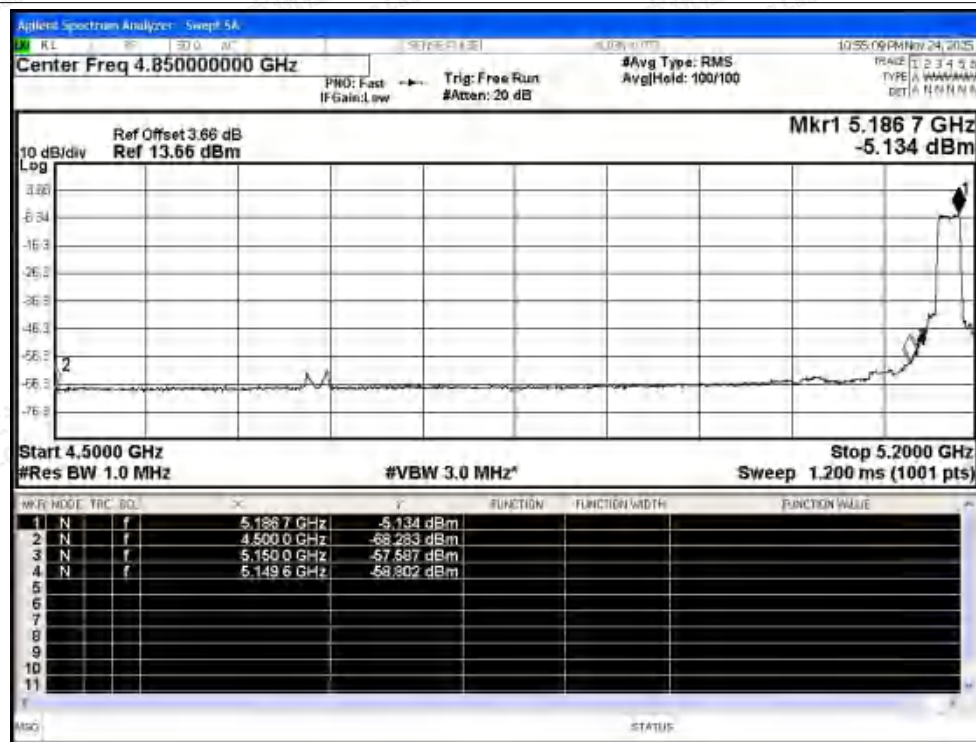




Restrict Band NVNT a 5240MHz Ant2 Peak

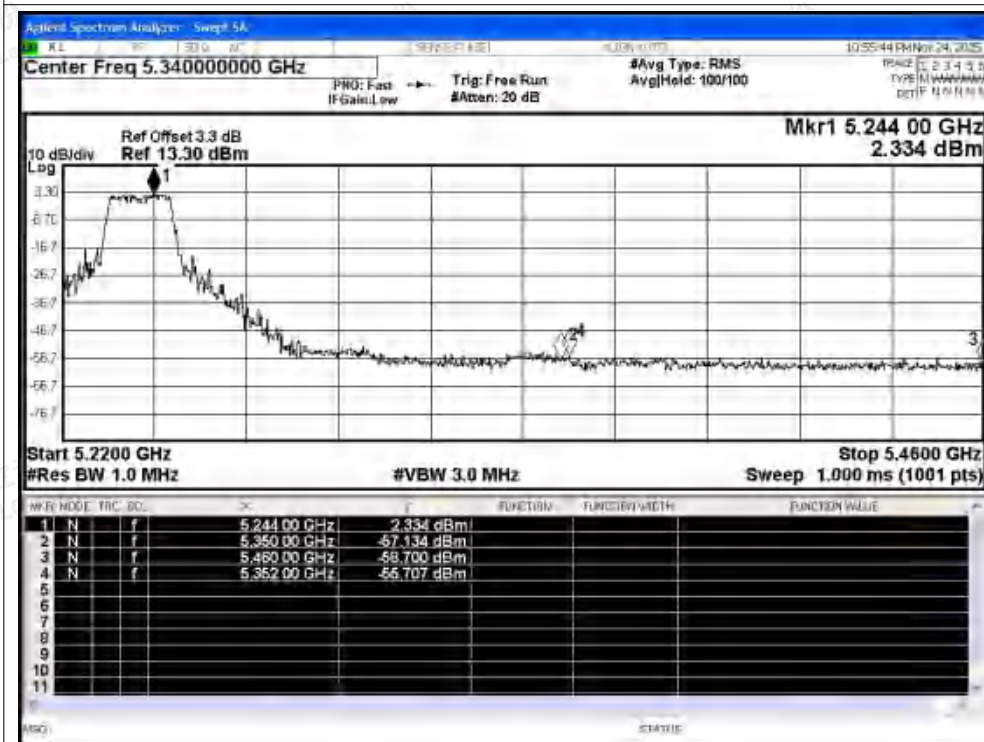


Restrict Band NVNT a 5240MHz Ant2 Average

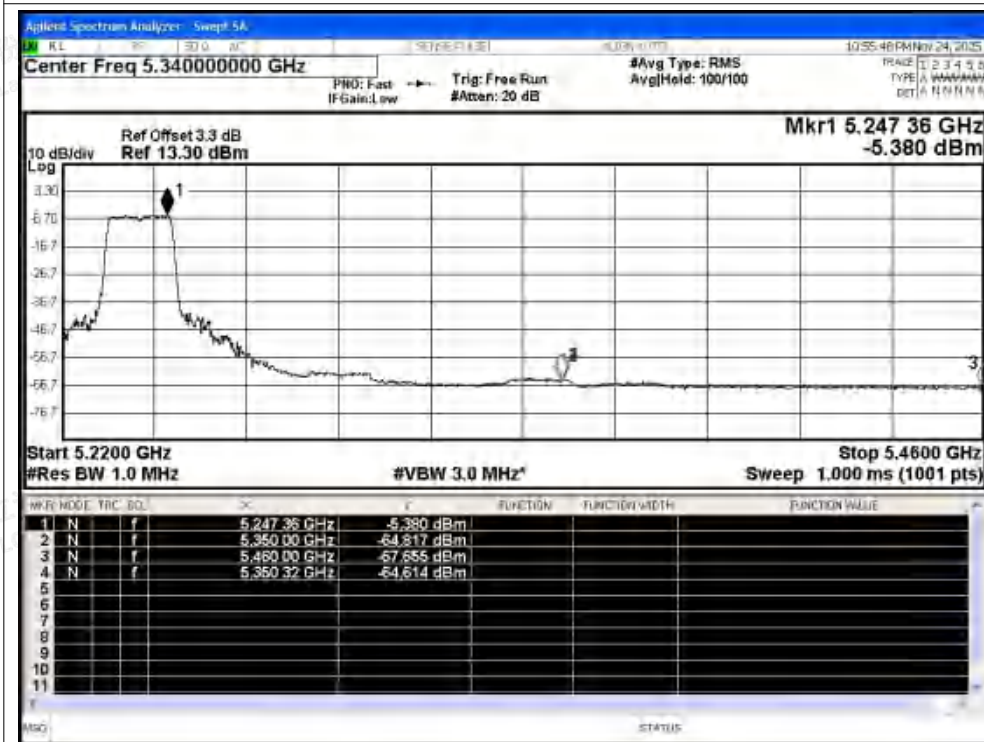




Restrict Band NVNT n20 5180MHz Ant2 Peak

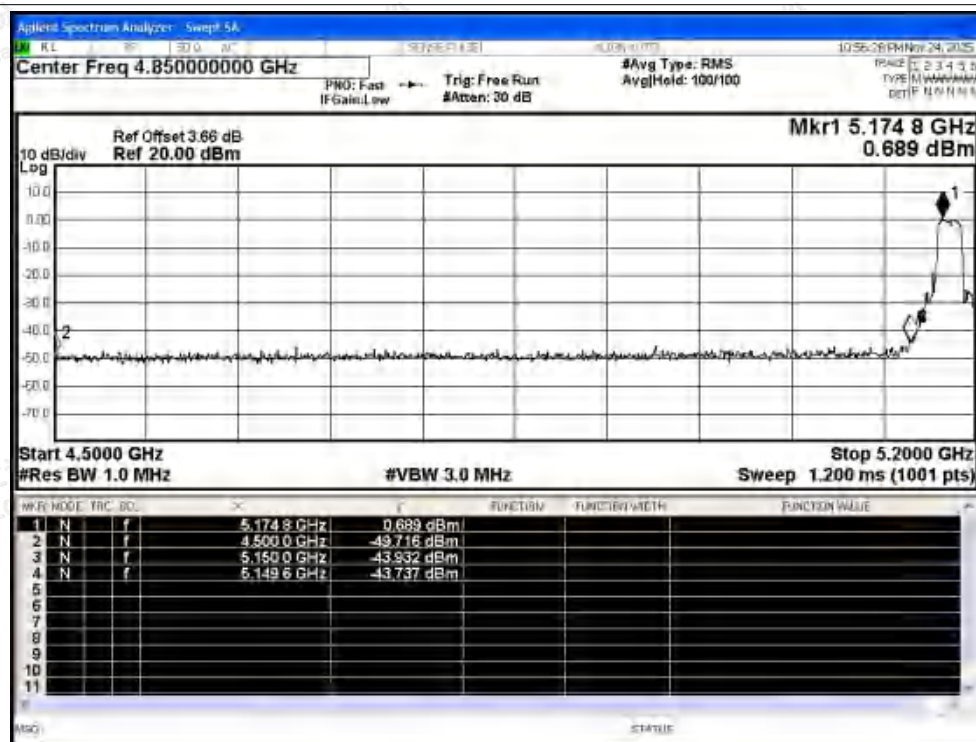

Restrict Band NVNT n20 5180MHz Ant2 Average

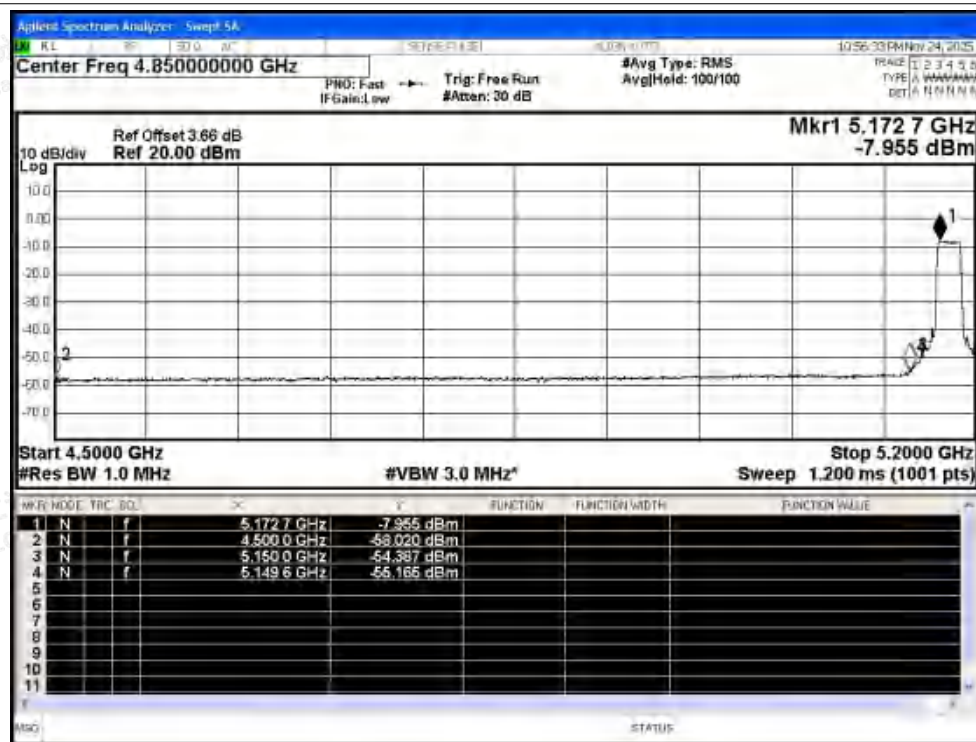


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

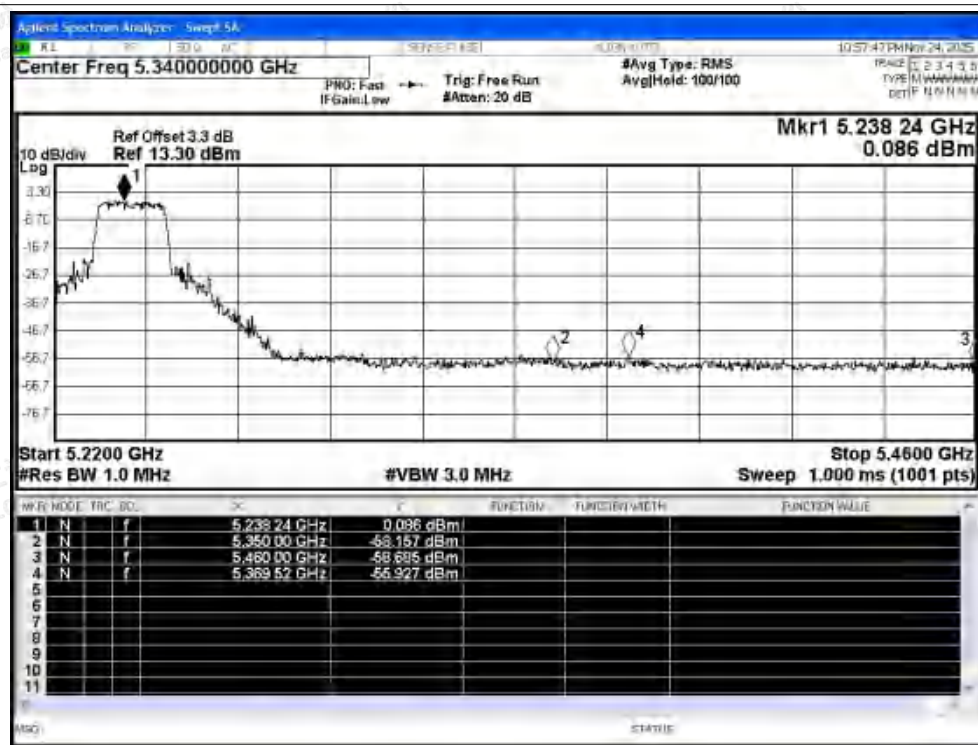

Restrict Band NVNT n20 5240MHz Ant2 Average

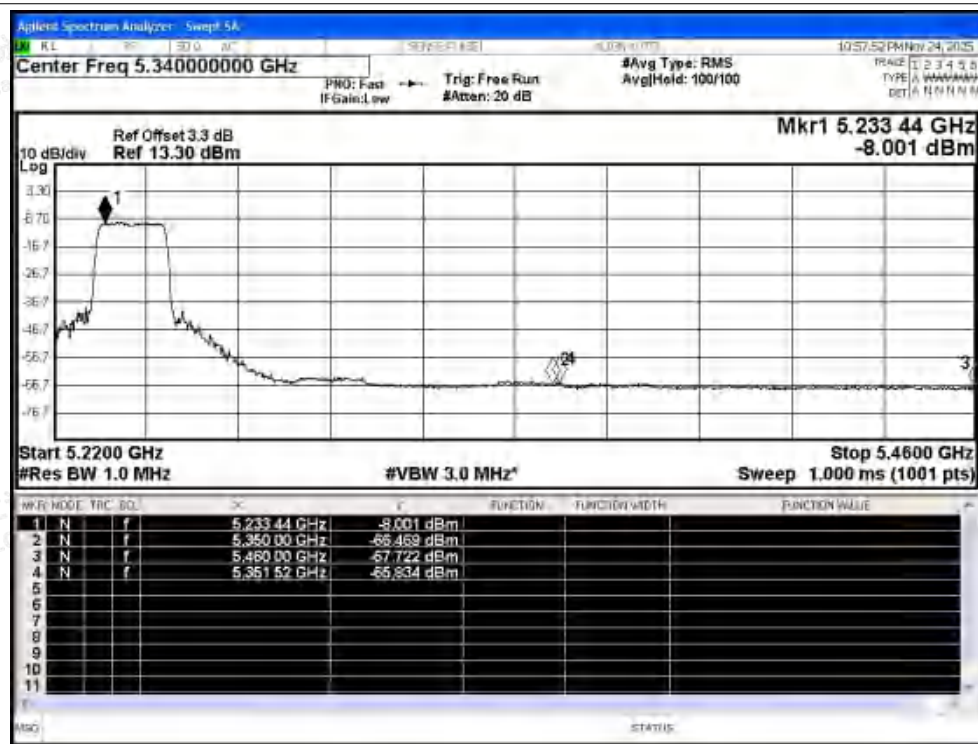

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant2 Peak

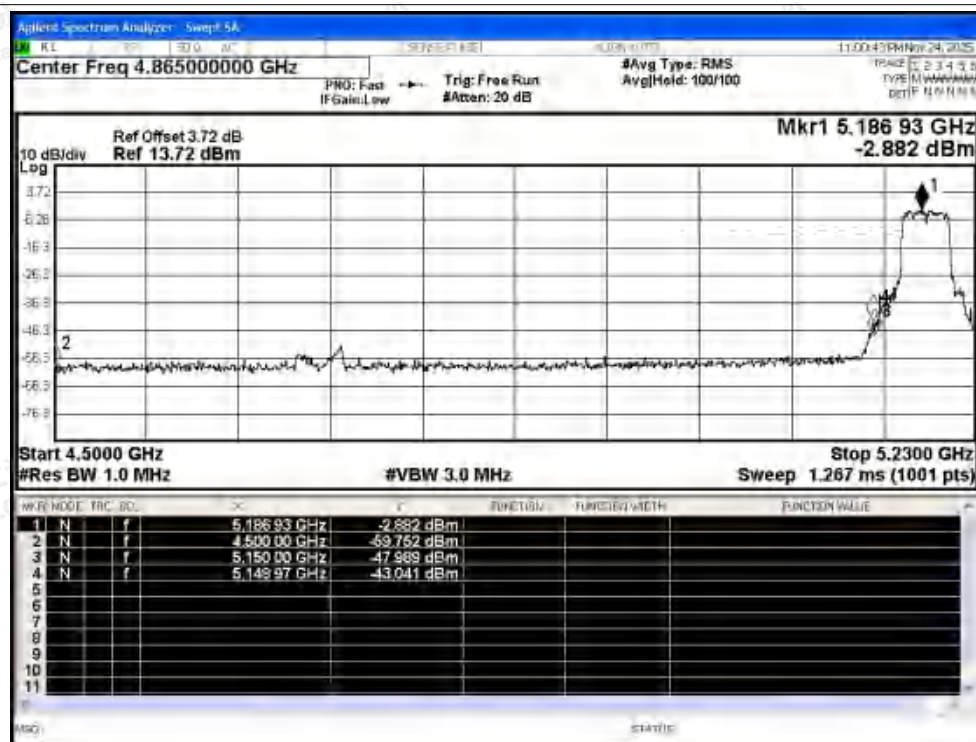

Restrict Band NVNT n40 5190MHz Ant2 Average

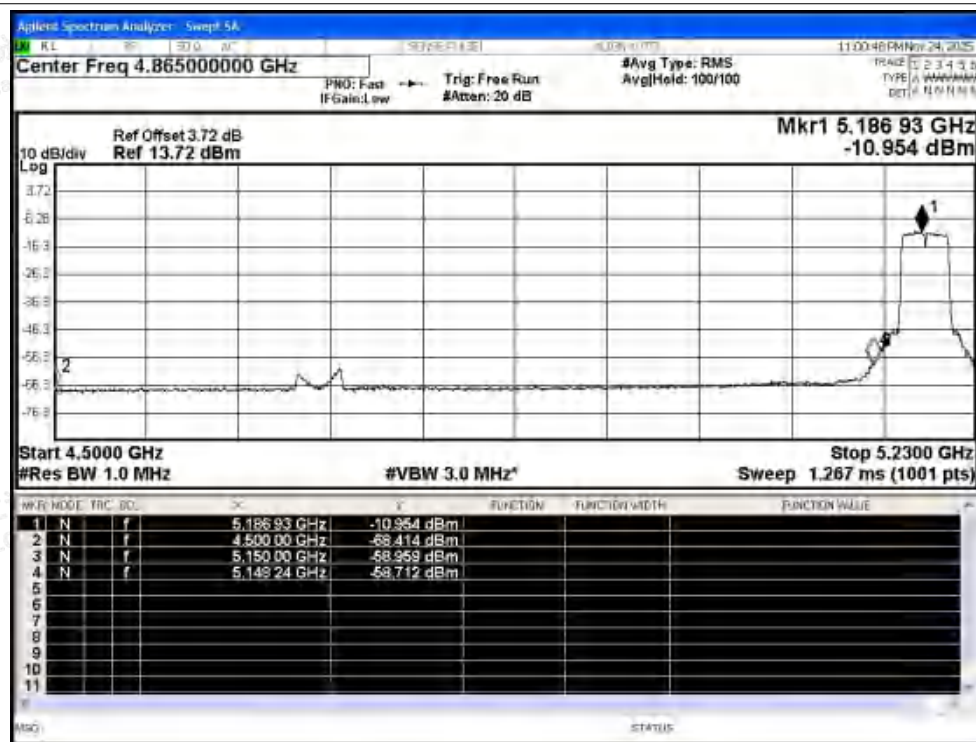




Restrict Band NVNT n40 5230MHz Ant2 Peak




Restrict Band NVNT n40 5230MHz Ant2 Average

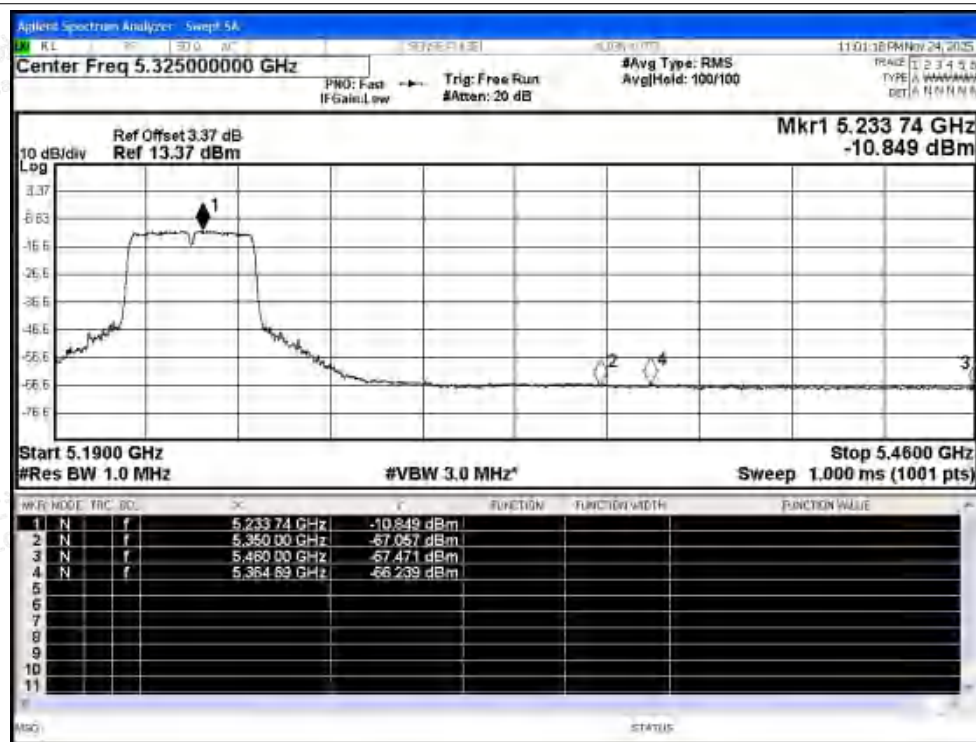




Restrict Band NVNT ac20 5180MHz Ant2 Peak

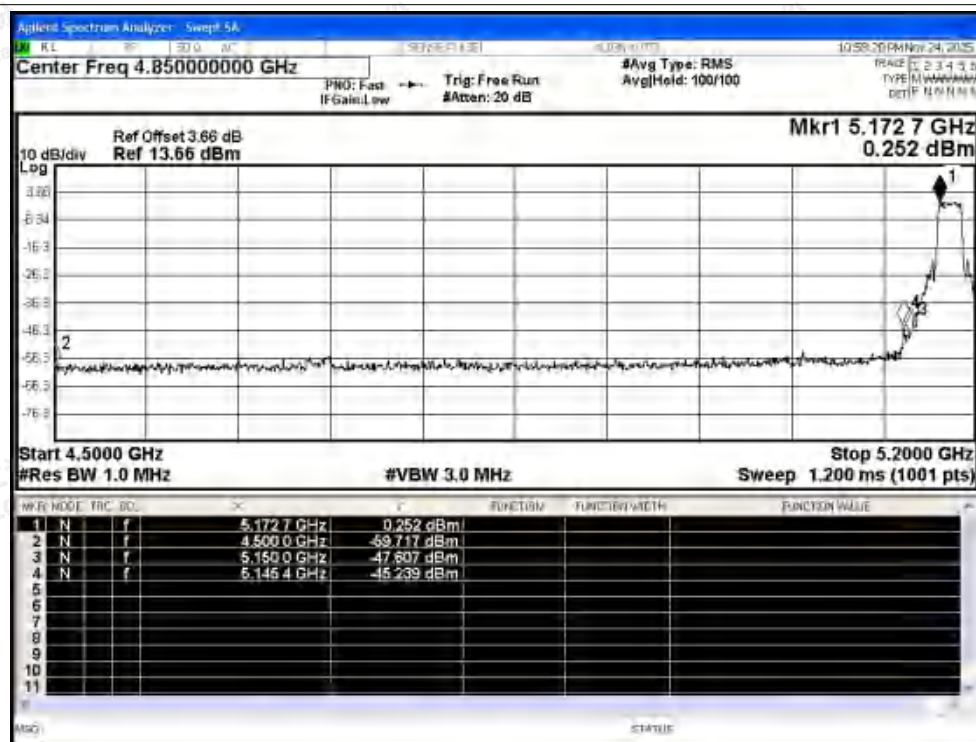

Restrict Band NVNT ac20 5180MHz Ant2 Average

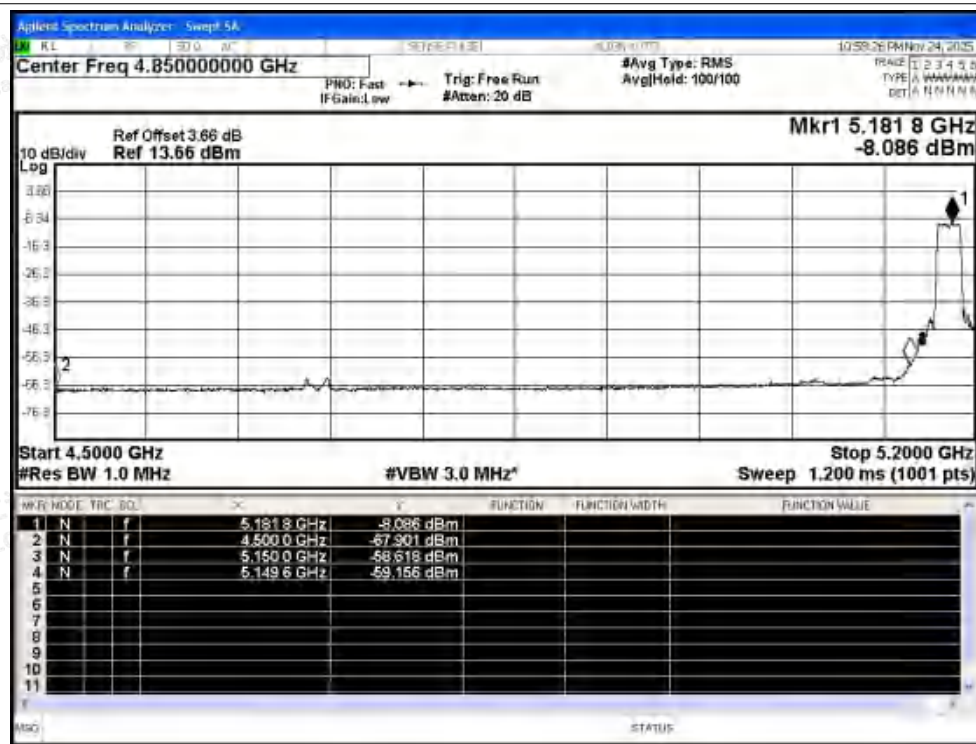


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant2 Peak

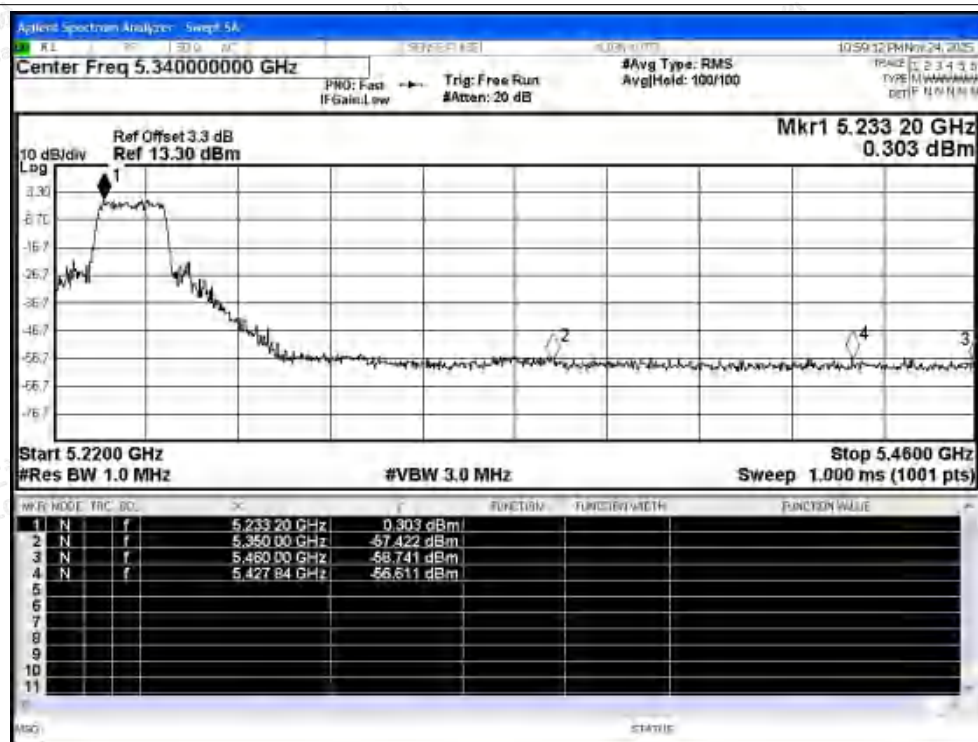

Restrict Band NVNT ac20 5240MHz Ant2 Average

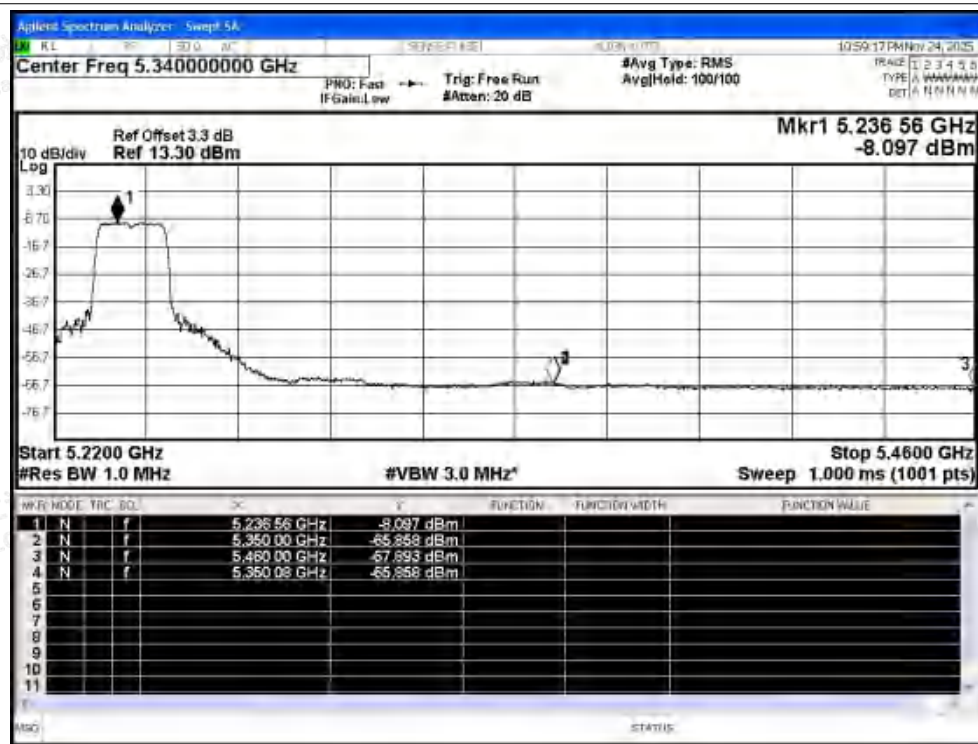

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant2 Peak

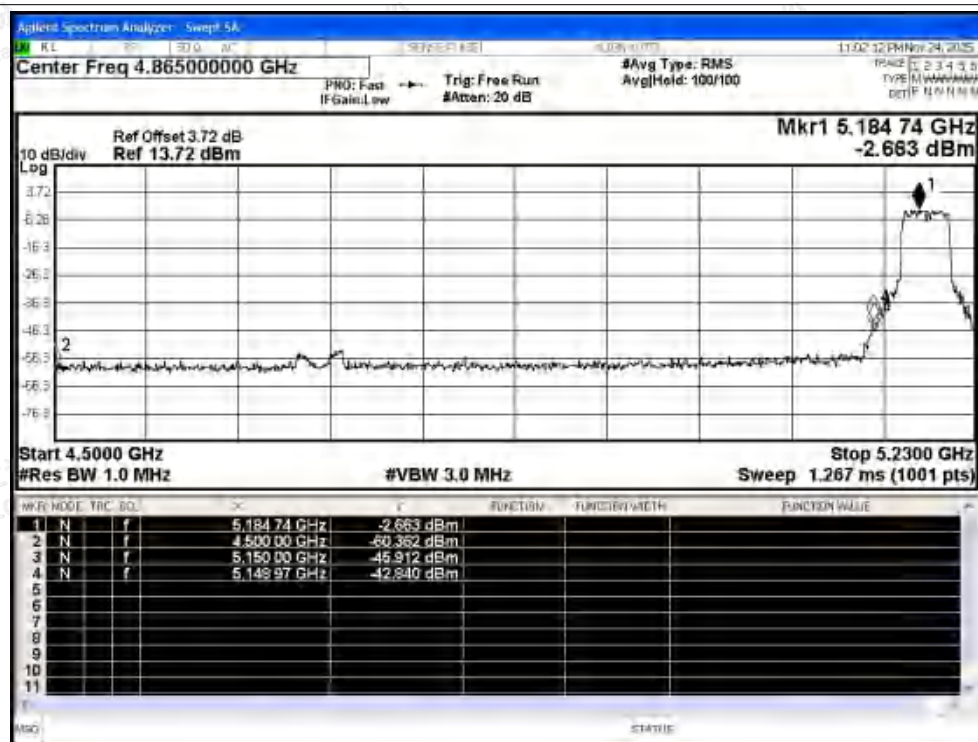

Restrict Band NVNT ac40 5190MHz Ant2 Average

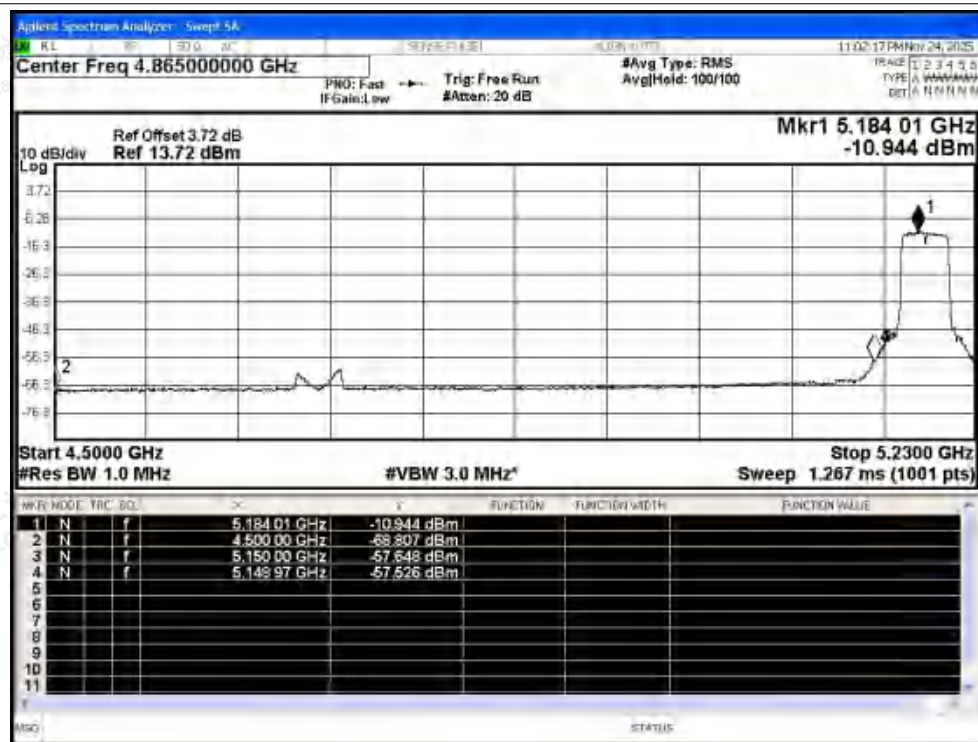

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant2 Peak

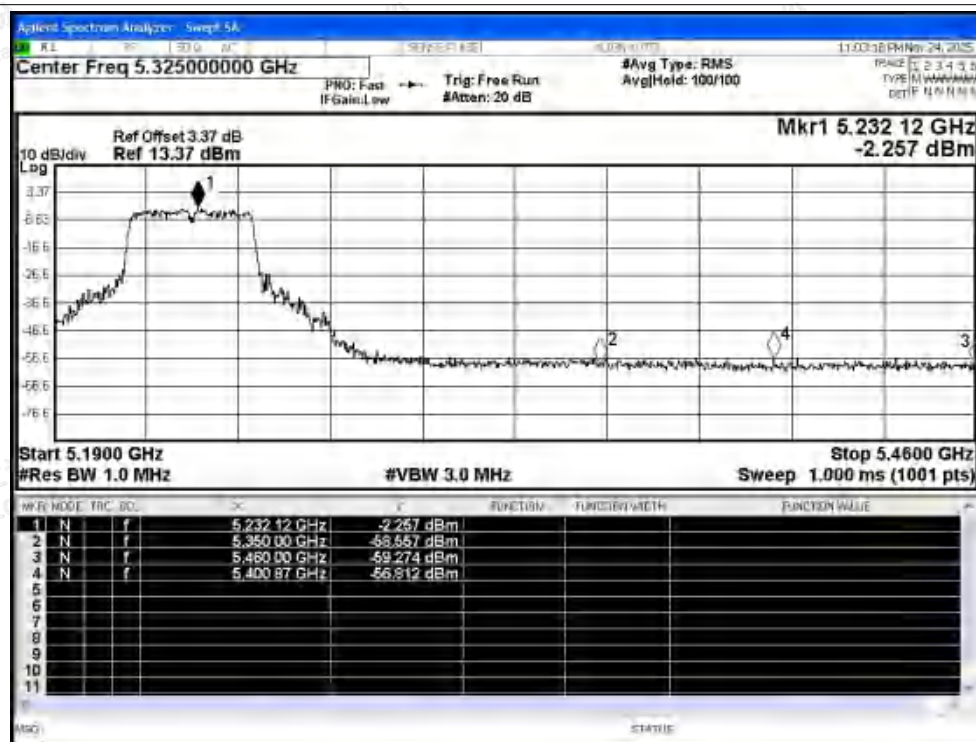

Restrict Band NVNT ac40 5230MHz Ant2 Average

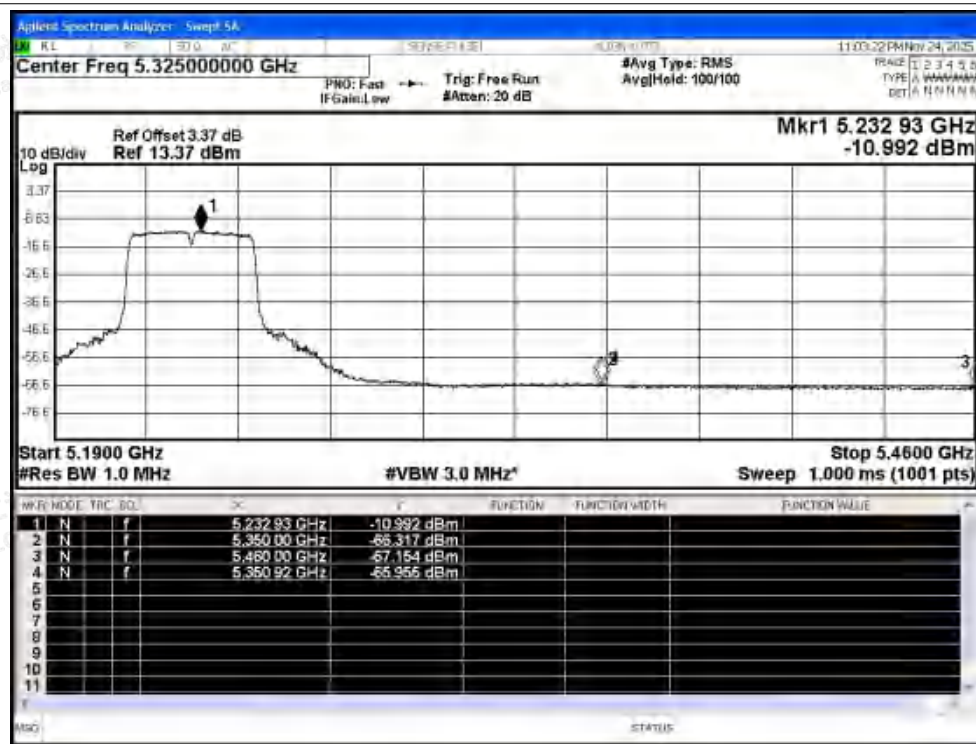

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

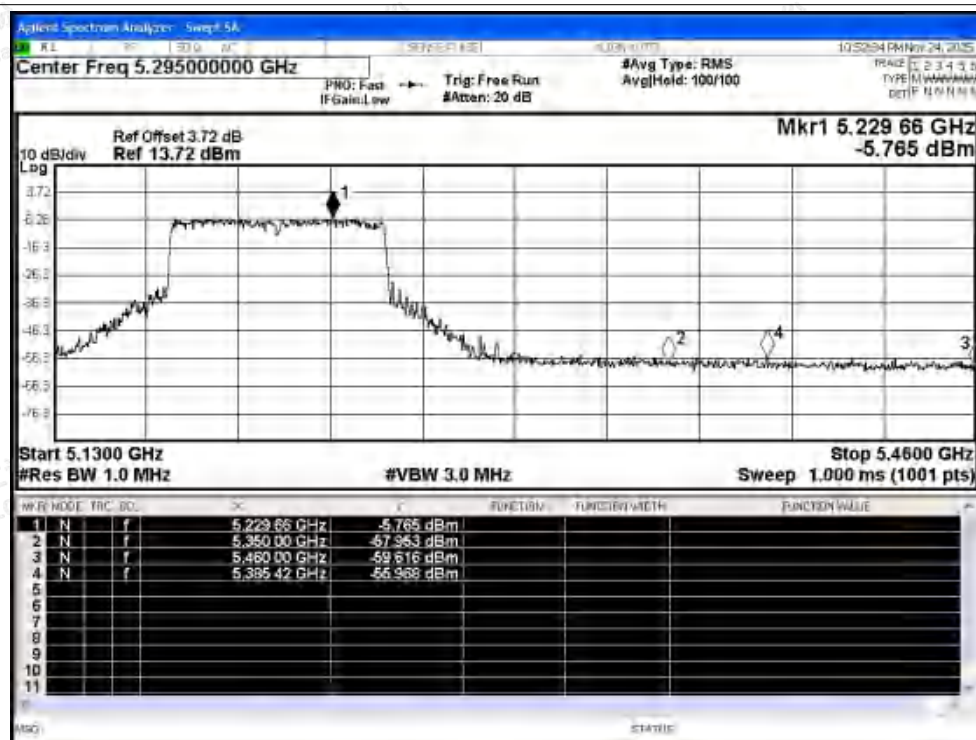


Restrict Band NVNT ac80 5210MHz Ant2 Average

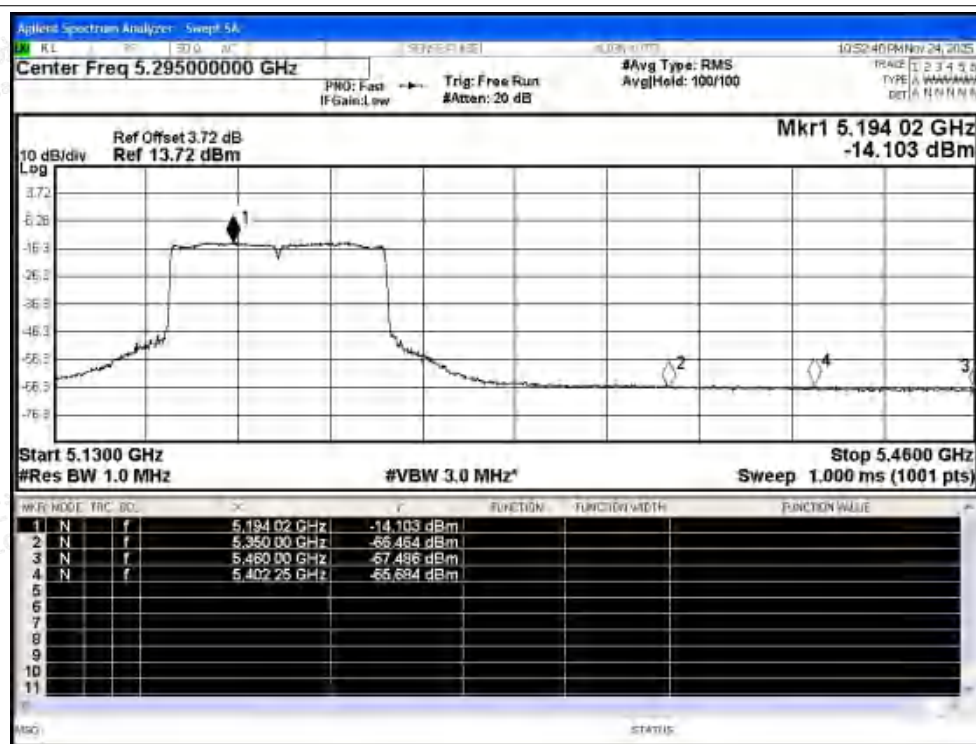




Restrict Band NVNT ac80 5210MHz Ant2 Peak

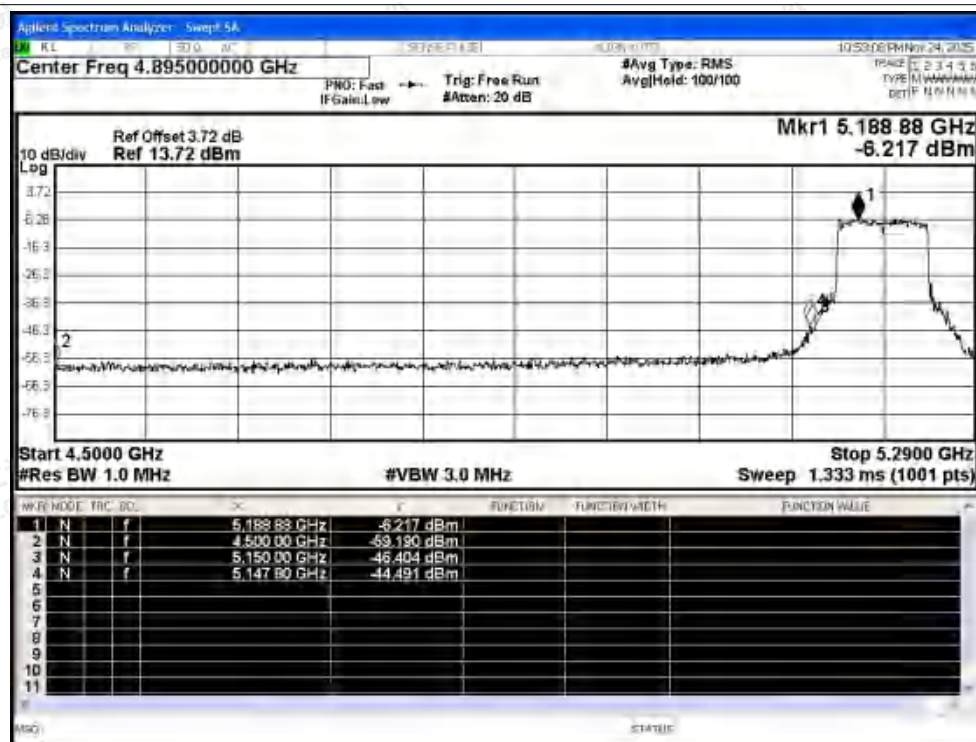

Restrict Band NVNT ac80 5210MHz Ant2 Average

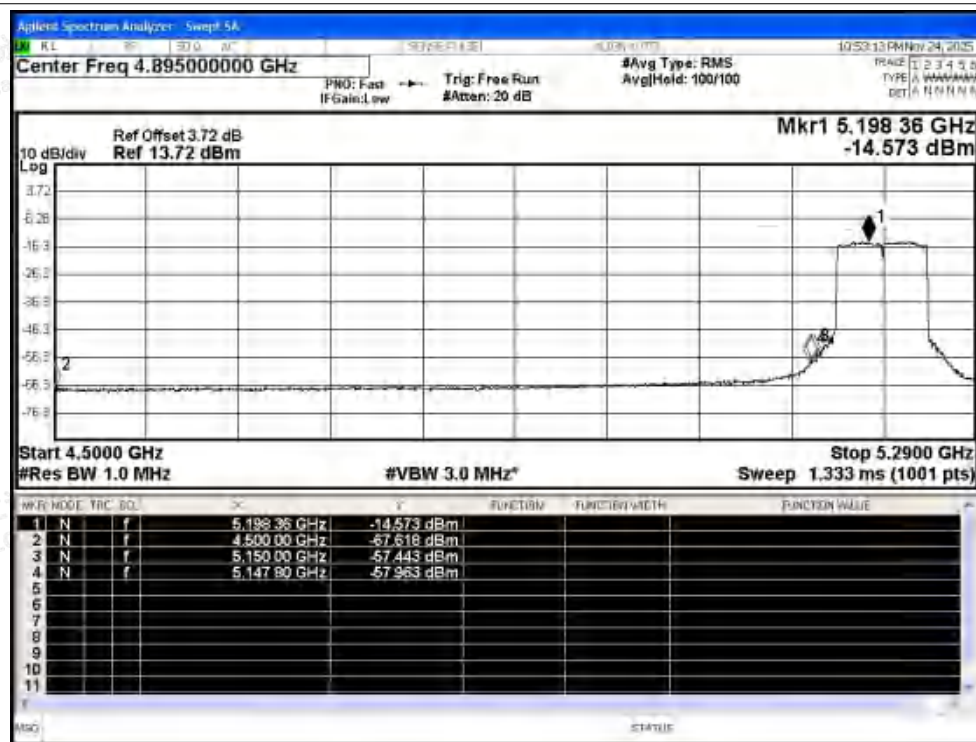

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant2 Peak

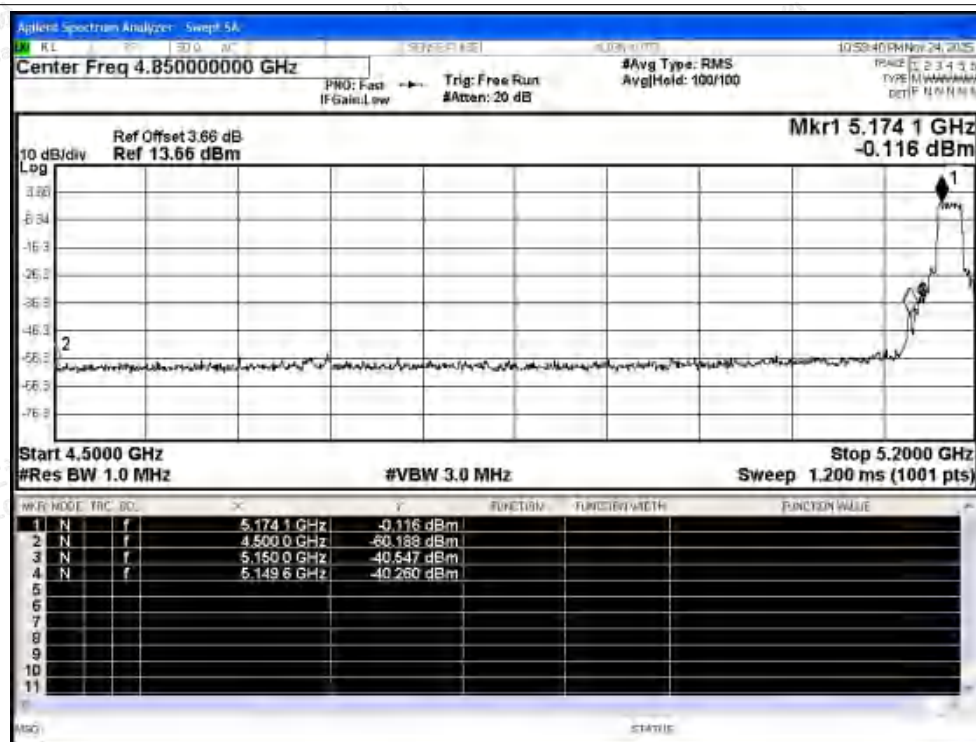

Restrict Band NVNT ax20 5180MHz Ant2 Average

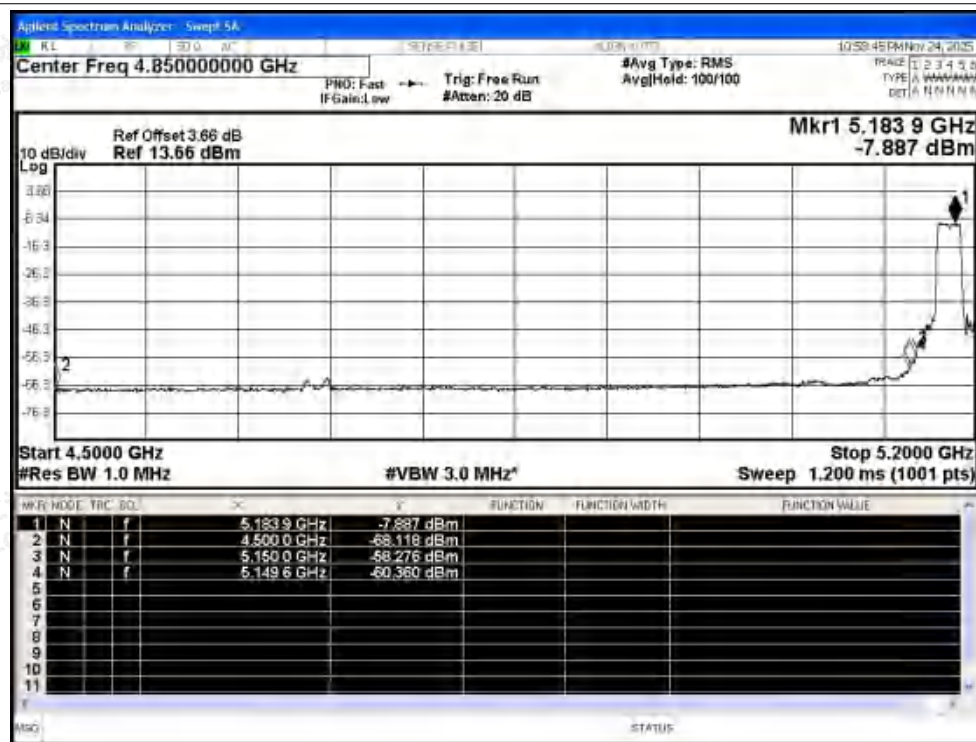

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant2 Peak

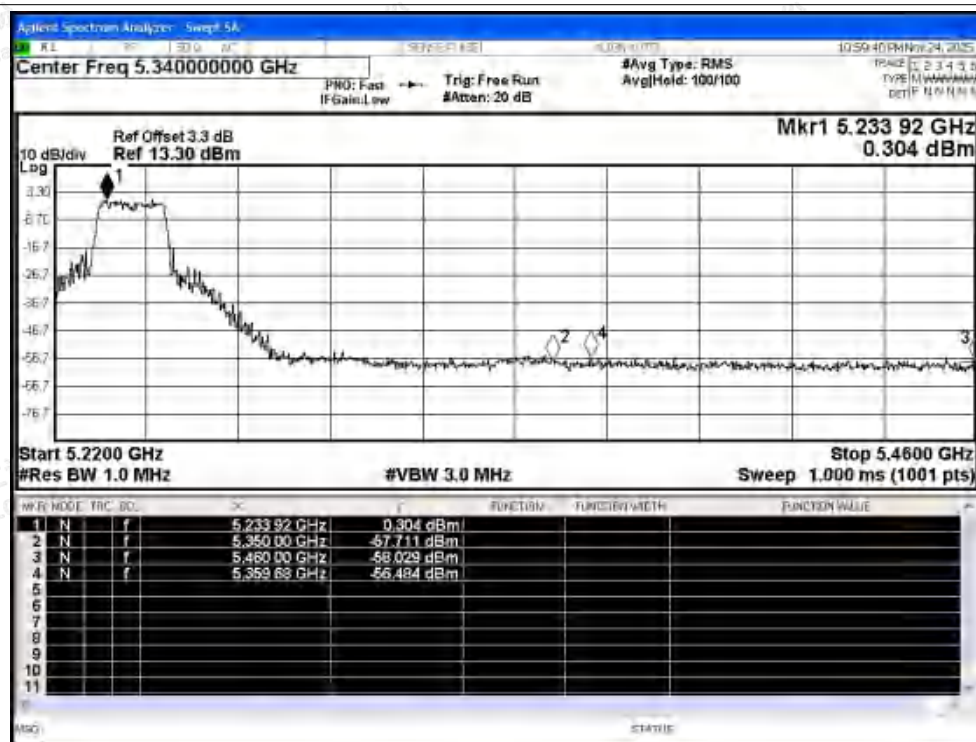

Restrict Band NVNT ax20 5240MHz Ant2 Average

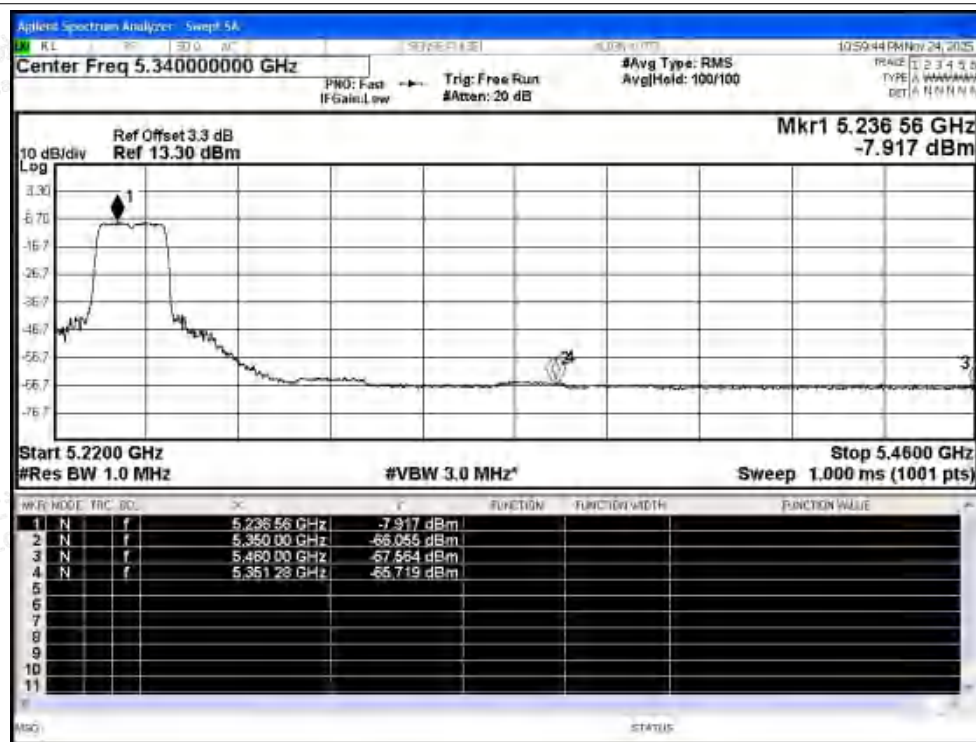

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant2 Peak

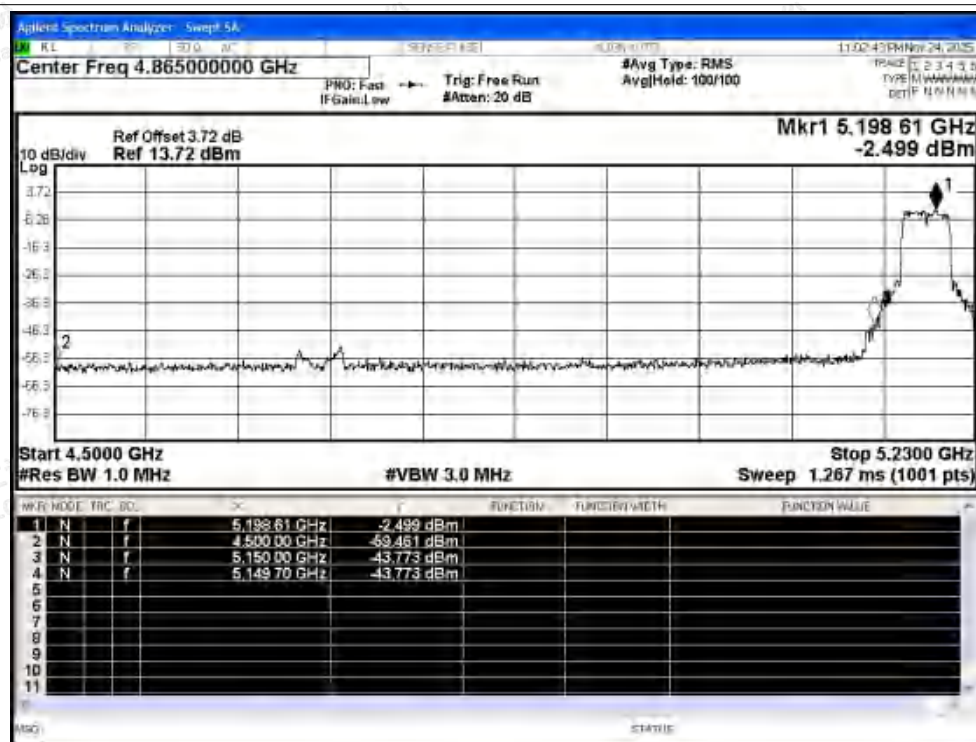

Restrict Band NVNT ax40 5190MHz Ant2 Average

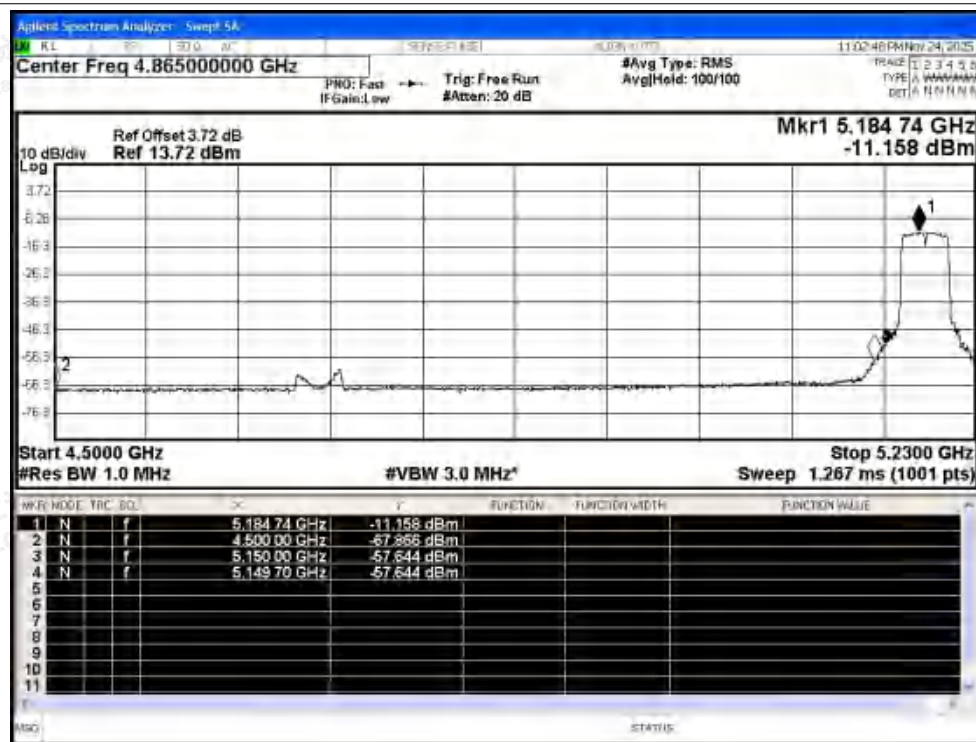


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant2 Peak



Restrict Band NVNT ax40 5230MHz Ant2 Average

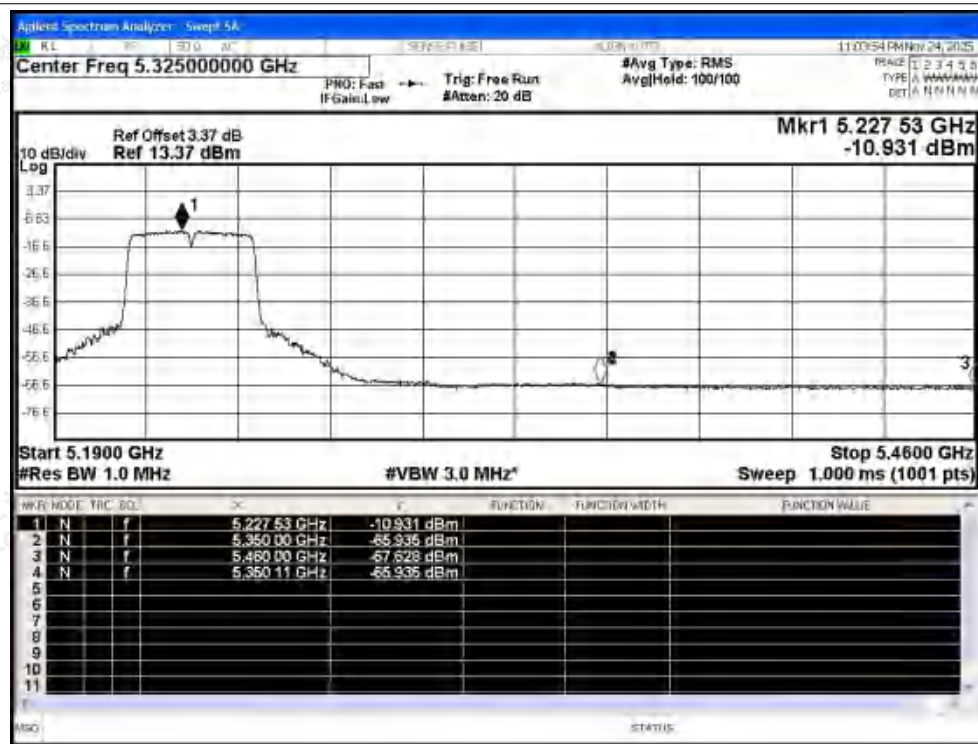

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

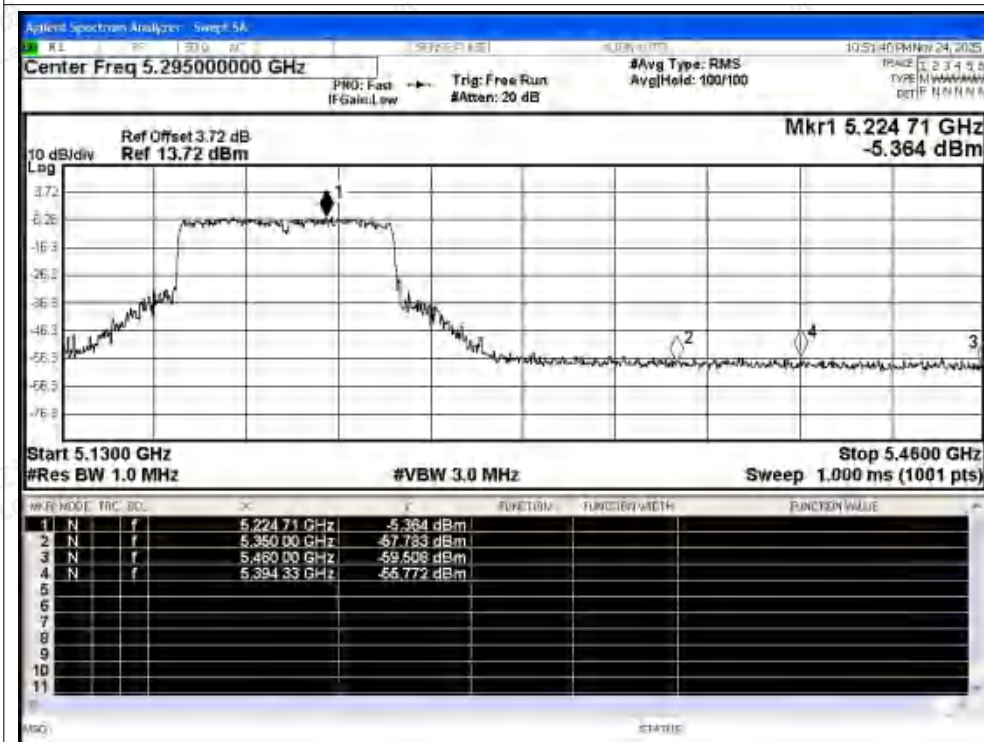

Restrict Band NVNT ax80 5210MHz Ant2 Average

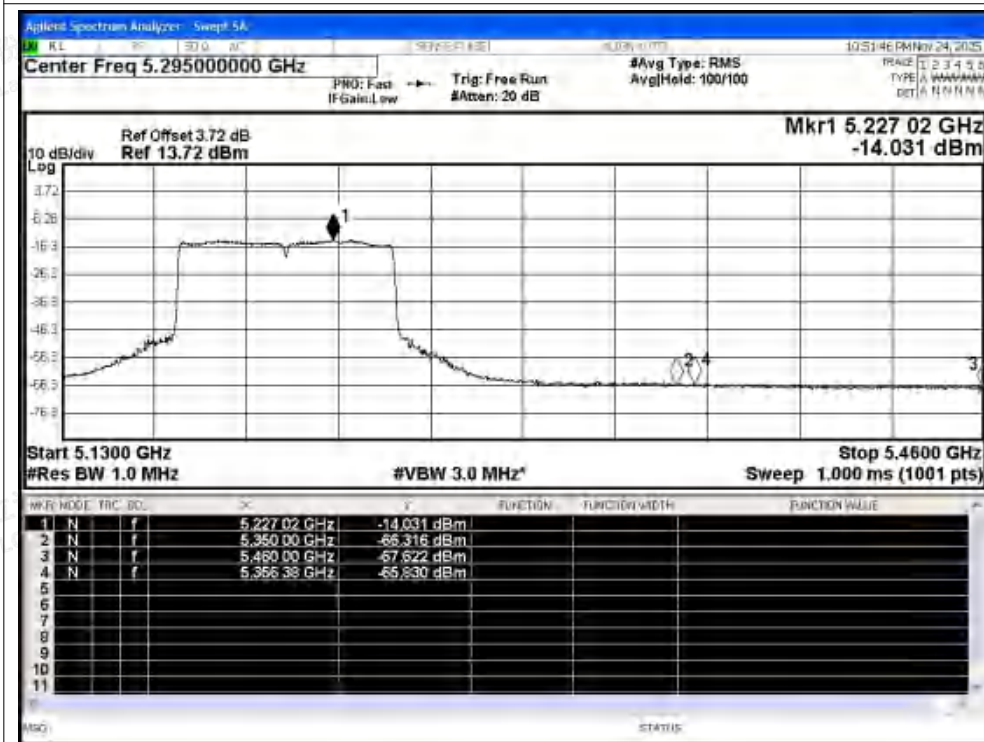

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

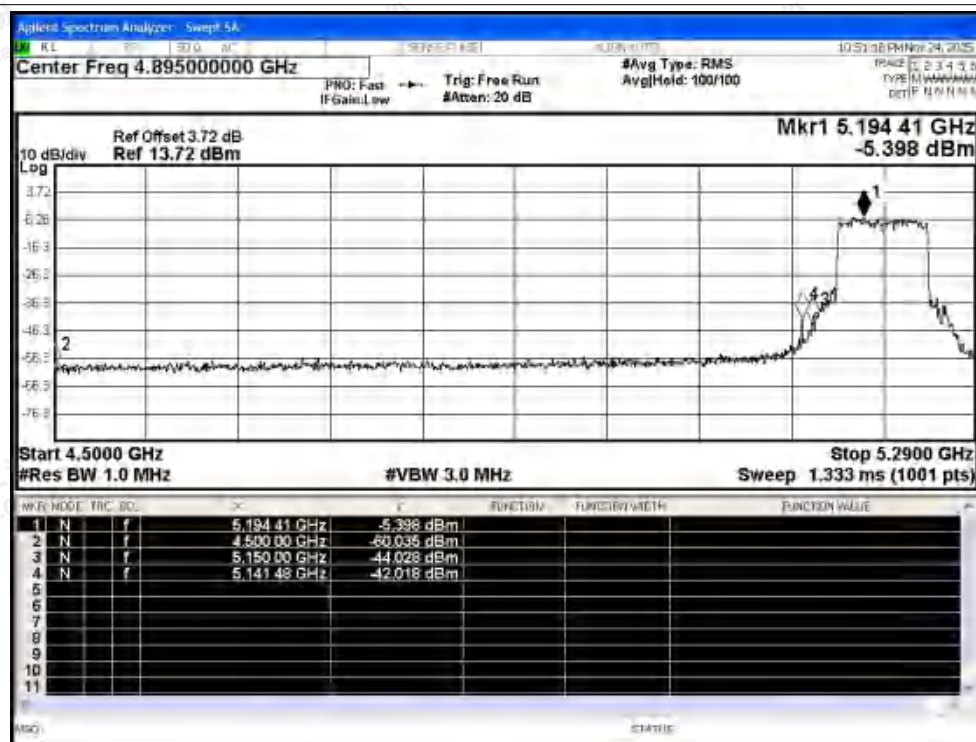

Restrict Band NVNT ax80 5210MHz Ant2 Average

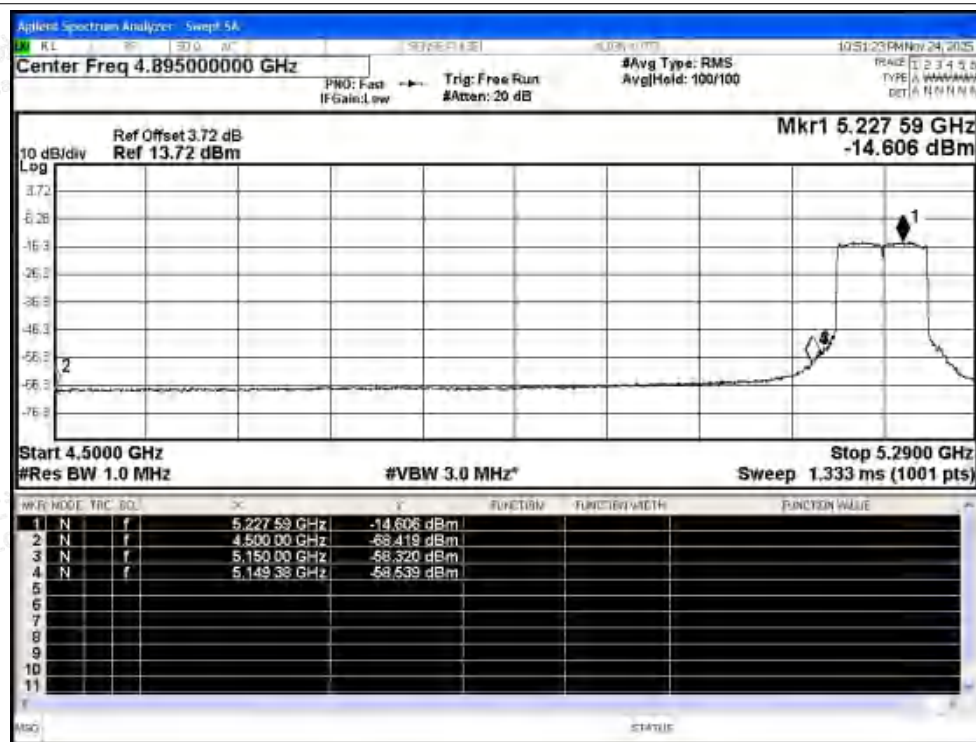


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant2 Peak

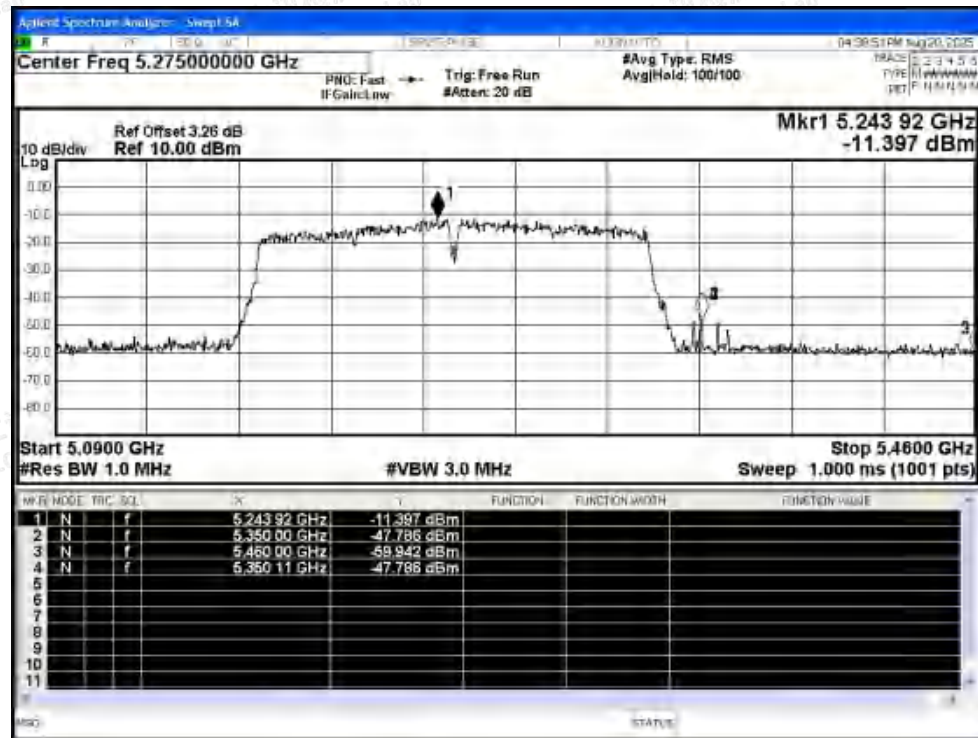

Restrict Band NVNT ac160 5250MHz Ant2 Average

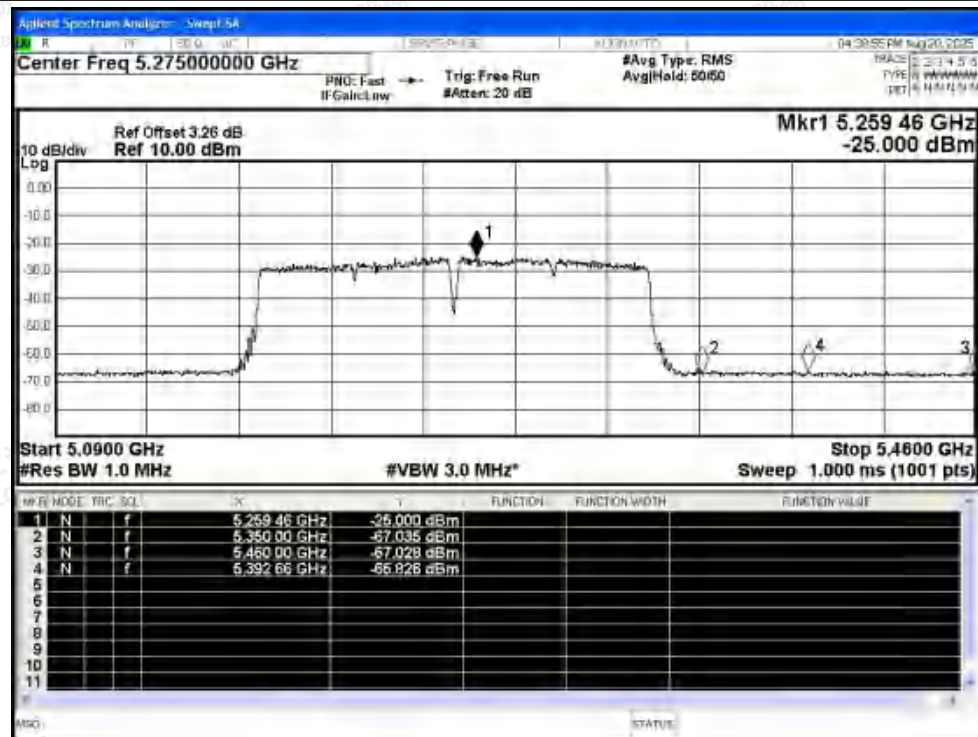




Restrict Band NVNT ac160 5250MHz Ant2 Peak



Restrict Band NVNT ac160 5250MHz Ant2 Average

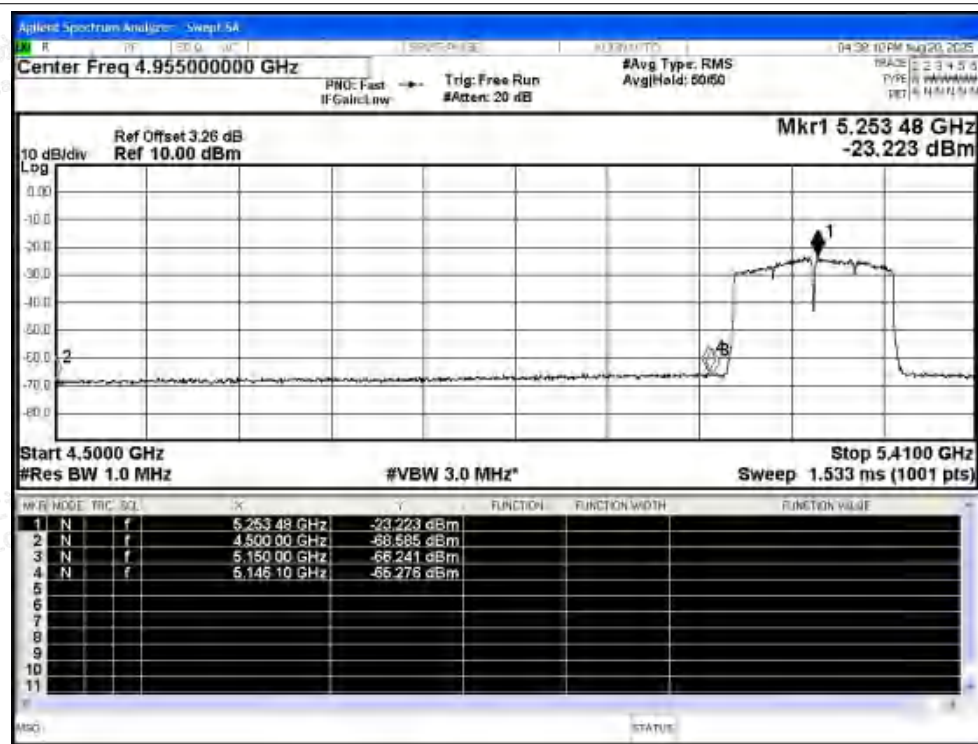

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant2 Peak

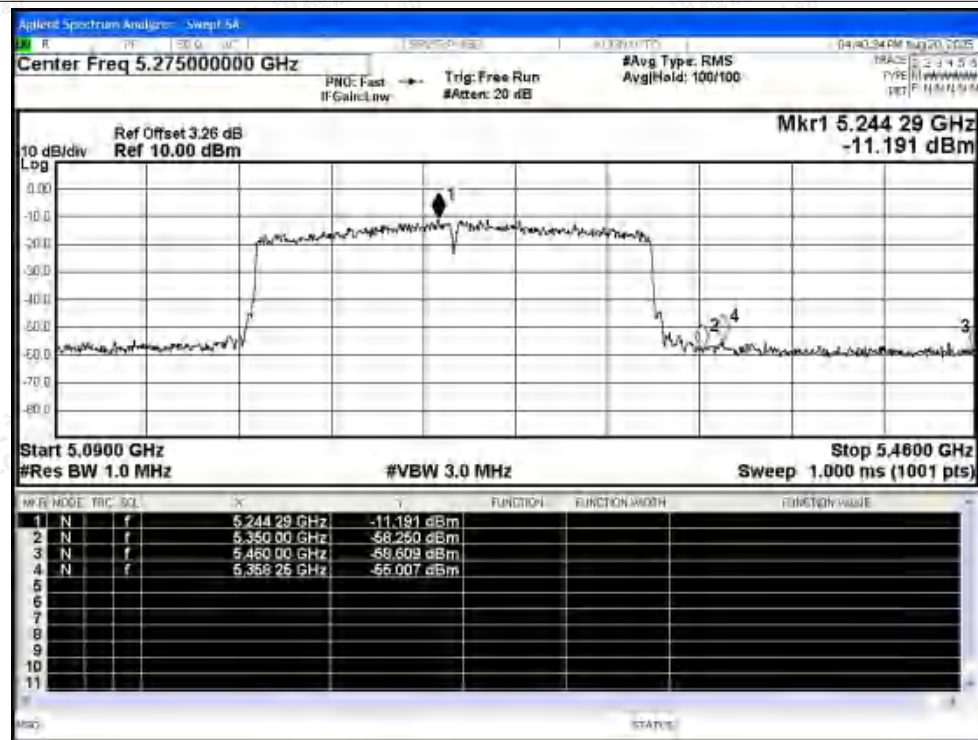

Restrict Band NVNT ax160 5250MHz Ant2 Average

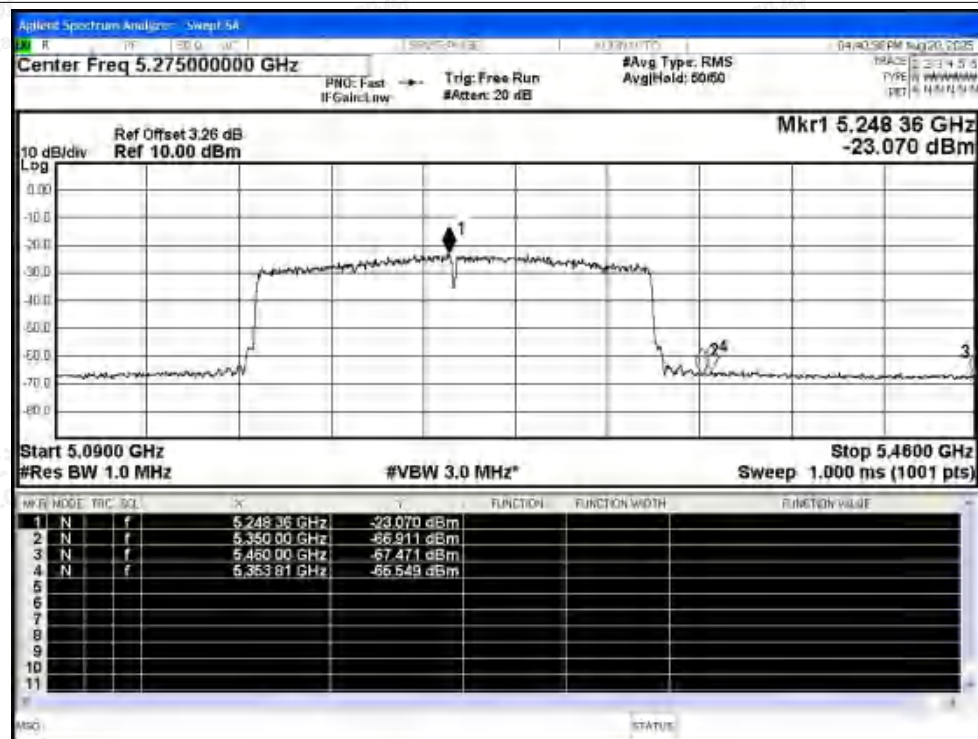

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant2 Peak

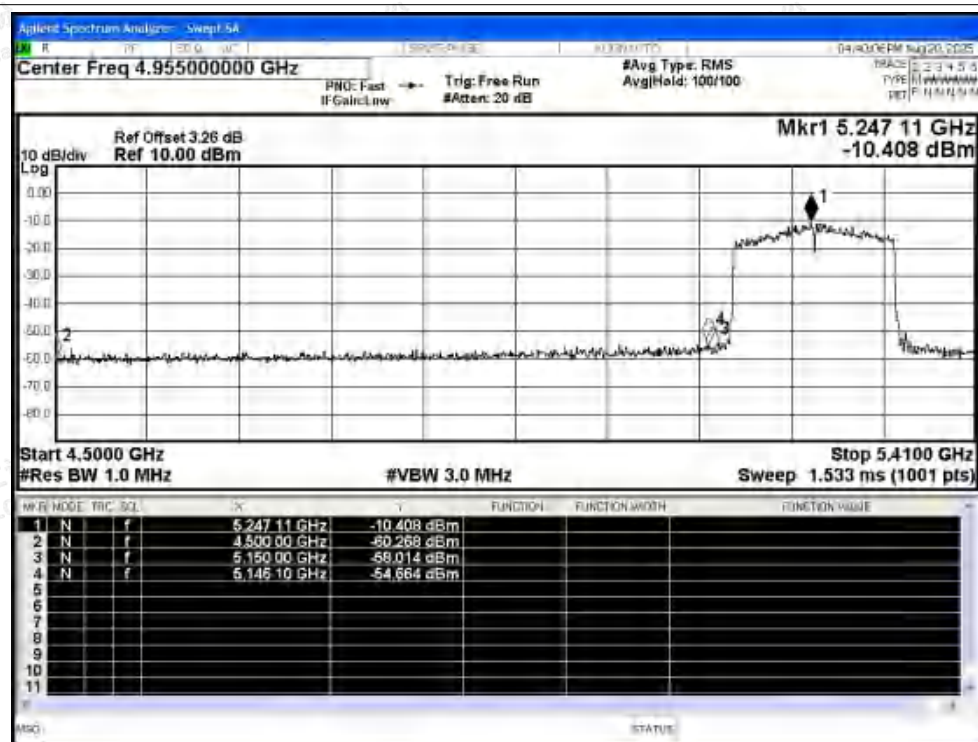

Restrict Band NVNT ax160 5250MHz Ant2 Average

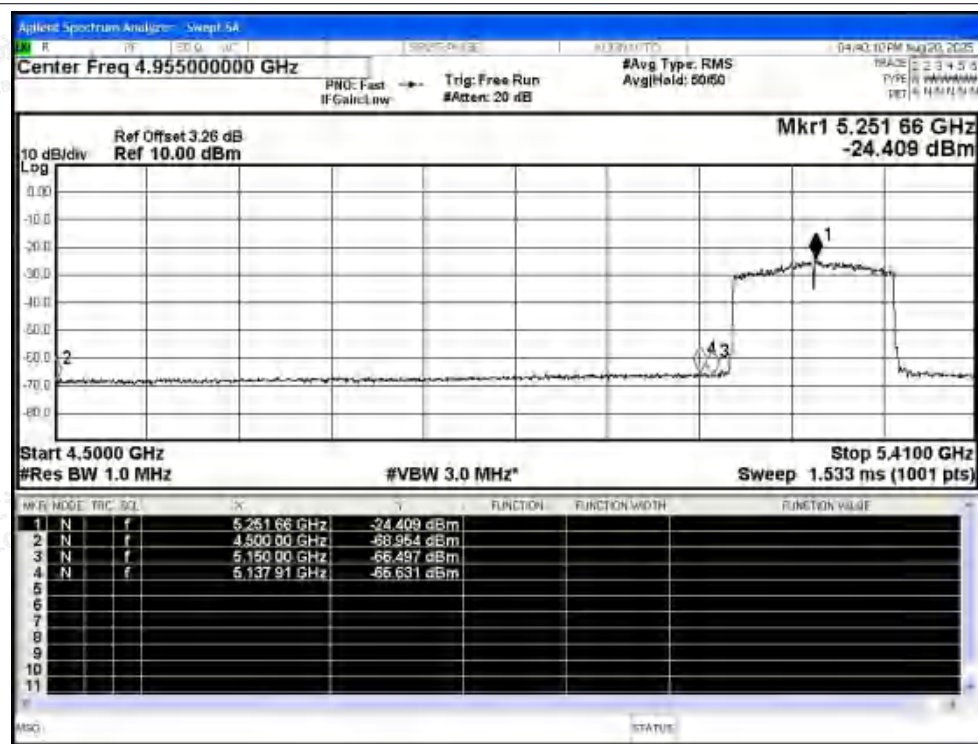


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-59.43	-49.72	7.95	45.95	Peak	68.2	Pass
NVNT	n20	5180	-68.09	-58.02	7.95	37.62	Average	54	Pass
NVNT	n20	5180	-47.79	-43.74	7.95	52.93	Peak	68.2	Pass
NVNT	n20	5180	-58.49	-55.17	7.95	41.72	Average	54	Pass
NVNT	n20	5180	-45.34	-43.93	7.95	53.66	Peak	68.2	Pass
NVNT	n20	5180	-57.88	-54.39	7.95	42.45	Average	54	Pass
NVNT	n20	5240	-56.16	-58.16	7.95	41.19	Peak	68.2	Pass
NVNT	n20	5240	-66.14	-66.47	7.95	31.94	Average	54	Pass
NVNT	n20	5240	-56.16	-55.93	7.95	42.2	Peak	68.2	Pass
NVNT	n20	5240	-65.62	-65.83	7.95	32.52	Average	54	Pass
NVNT	n20	5240	-59.74	-58.69	7.95	39.06	Peak	68.2	Pass
NVNT	n20	5240	-67.71	-67.72	7.95	30.53	Average	54	Pass
NVNT	n40	5190	-60.47	-59.75	7.95	38.15	Peak	68.2	Pass
NVNT	n40	5190	-68.74	-68.41	7.95	29.67	Average	54	Pass
NVNT	n40	5190	-43.76	-43.04	7.95	54.86	Peak	68.2	Pass
NVNT	n40	5190	-57.6	-58.71	7.95	40.12	Average	54	Pass
NVNT	n40	5190	-43.76	-47.99	7.95	52.86	Peak	68.2	Pass
NVNT	n40	5190	-57.65	-58.96	7.95	39.98	Average	54	Pass
NVNT	n40	5230	-59.4	-57.86	7.95	39.68	Peak	68.2	Pass
NVNT	n40	5230	-66.58	-67.06	7.95	31.43	Average	54	Pass
NVNT	n40	5230	-56.49	-56.46	7.95	41.77	Peak	68.2	Pass
NVNT	n40	5230	-65.96	-66.24	7.95	32.14	Average	54	Pass
NVNT	n40	5230	-59.85	-58.34	7.95	39.21	Peak	68.2	Pass
NVNT	n40	5230	-67.43	-67.47	7.95	30.79	Average	54	Pass
NVNT	ac20	5180	-60.7	-59.72	7.95	38.06	Peak	68.2	Pass
NVNT	ac20	5180	-67.85	-67.9	7.95	30.37	Average	54	Pass
NVNT	ac20	5180	-43.51	-45.24	7.95	53.95	Peak	68.2	Pass
NVNT	ac20	5180	-59.11	-59.16	7.95	39.11	Average	54	Pass
NVNT	ac20	5180	-47.65	-47.61	7.95	50.61	Peak	68.2	Pass
NVNT	ac20	5180	-59.83	-58.62	7.95	39.06	Average	54	Pass
NVNT	ac20	5240	-57.48	-57.42	7.95	40.79	Peak	68.2	Pass
NVNT	ac20	5240	-66.29	-65.86	7.95	32.17	Average	54	Pass
NVNT	ac20	5240	-56.38	-56.61	7.95	41.75	Peak	68.2	Pass
NVNT	ac20	5240	-66.12	-65.86	7.95	32.25	Average	54	Pass
NVNT	ac20	5240	-60.76	-58.74	7.95	38.61	Peak	68.2	Pass
NVNT	ac20	5240	-68.24	-67.89	7.95	30.18	Average	54	Pass
NVNT	ac40	5190	-59.96	-60.36	7.95	38.08	Peak	68.2	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	-68.12	-68.81	7.95	29.79	Average	54	Pass
NVNT	ac40	5190	-35.04	-42.84	7.95	60.86	Peak	68.2	Pass
NVNT	ac40	5190	-58.12	-57.53	7.95	40.43	Average	54	Pass
NVNT	ac40	5190	-35.04	-45.91	7.95	60.53	Peak	68.2	Pass
NVNT	ac40	5190	-58.92	-57.65	7.95	40.00	Average	54	Pass
NVNT	ac40	5230	-58.76	-58.56	7.95	39.58	Peak	68.2	Pass
NVNT	ac40	5230	-66.19	-66.32	7.95	31.99	Average	54	Pass
NVNT	ac40	5230	-56.69	-56.81	7.95	41.49	Peak	68.2	Pass
NVNT	ac40	5230	-66.13	-65.96	7.95	32.2	Average	54	Pass
NVNT	ac40	5230	-58.35	-59.27	7.95	39.45	Peak	68.2	Pass
NVNT	ac40	5230	-67.47	-67.15	7.95	30.93	Average	54	Pass
NVNT	ac80	5210	-57.5	-57.95	7.95	40.52	Peak	68.2	Pass
NVNT	ac80	5210	-66.31	-66.46	7.95	31.86	Average	54	Pass
NVNT	ac80	5210	-56.18	-55.97	7.95	42.17	Peak	68.2	Pass
NVNT	ac80	5210	-65.75	-65.68	7.95	32.53	Average	54	Pass
NVNT	ac80	5210	-59.34	-59.62	7.95	38.76	Peak	68.2	Pass
NVNT	ac80	5210	-67.48	-67.49	7.95	30.76	Average	54	Pass
NVNT	ac80	5210	-58.25	-59.19	7.95	39.55	Peak	68.2	Pass
NVNT	ac80	5210	-67.85	-67.62	7.95	30.51	Average	54	Pass
NVNT	ac80	5210	-44.55	-44.49	7.95	53.72	Peak	68.2	Pass
NVNT	ac80	5210	-58.04	-57.96	7.95	40.24	Average	54	Pass
NVNT	ac80	5210	-48.29	-46.4	7.95	51.00	Peak	68.2	Pass
NVNT	ac80	5210	-58.81	-57.44	7.95	40.17	Average	54	Pass
NVNT	ax20	5180	-59	-60.19	7.95	38.69	Peak	68.2	Pass
NVNT	ax20	5180	-68.91	-68.12	7.95	29.74	Average	54	Pass
NVNT	ax20	5180	-43.92	-40.26	7.95	56.52	Peak	68.2	Pass
NVNT	ax20	5180	-59.66	-60.36	7.95	38.24	Average	54	Pass
NVNT	ax20	5180	-45.47	-40.55	7.95	55.89	Peak	68.2	Pass
NVNT	ax20	5180	-58.19	-58.28	7.95	40.01	Average	54	Pass
NVNT	ax20	5240	-58.55	-57.71	7.95	40.13	Peak	68.2	Pass
NVNT	ax20	5240	-65.9	-66.06	7.95	32.26	Average	54	Pass
NVNT	ax20	5240	-56.46	-56.48	7.95	41.77	Peak	68.2	Pass
NVNT	ax20	5240	-65.9	-65.72	7.95	32.43	Average	54	Pass
NVNT	ax20	5240	-60.52	-58.03	7.95	39.14	Peak	68.2	Pass
NVNT	ax20	5240	-67.76	-67.56	7.95	30.58	Average	54	Pass
NVNT	ax40	5190	-59.81	-59.46	7.95	38.61	Peak	68.2	Pass
NVNT	ax40	5190	-68.6	-67.87	7.95	30.02	Average	54	Pass
NVNT	ax40	5190	-43.67	-43.77	7.95	54.52	Peak	68.2	Pass
NVNT	ax40	5190	-57.74	-57.64	7.95	40.55	Average	54	Pass
NVNT	ax40	5190	-48.47	-43.77	7.95	52.73	Peak	68.2	Pass
NVNT	ax40	5190	-57.74	-57.64	7.95	40.55	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	-57.93	-58.23	7.95	40.16	Peak	68.2	Pass
NVNT	ax40	5230	-66.27	-65.94	7.95	32.14	Average	54	Pass
NVNT	ax40	5230	-56.54	-55.89	7.95	42.04	Peak	68.2	Pass
NVNT	ax40	5230	-66.27	-65.94	7.95	32.14	Average	54	Pass
NVNT	ax40	5230	-59.51	-59.39	7.95	38.79	Peak	68.2	Pass
NVNT	ax40	5230	-68.31	-67.63	7.95	30.28	Average	54	Pass
NVNT	ax80	5210	-58.07	-57.78	7.95	40.32	Peak	68.2	Pass
NVNT	ax80	5210	-66.89	-66.32	7.95	31.64	Average	54	Pass
NVNT	ax80	5210	-55.86	-55.77	7.95	42.43	Peak	68.2	Pass
NVNT	ax80	5210	-65.66	-65.83	7.95	32.5	Average	54	Pass
NVNT	ax80	5210	-59.34	-59.51	7.95	38.82	Peak	68.2	Pass
NVNT	ax80	5210	-66.86	-67.62	7.95	31.02	Average	54	Pass
NVNT	ax80	5210	-60.04	-60.04	7.95	38.2	Peak	68.2	Pass
NVNT	ax80	5210	-68.08	-68.42	7.95	29.99	Average	54	Pass
NVNT	ax80	5210	-43.96	-42.02	7.95	55.36	Peak	68.2	Pass
NVNT	ax80	5210	-58.44	-58.54	7.95	39.75	Average	54	Pass
NVNT	ax80	5210	-42.66	-44.03	7.95	54.95	Peak	68.2	Pass
NVNT	ax80	5210	-58.43	-58.32	7.95	39.87	Average	54	Pass
NVNT	ac160	5250	-56.73	-47.79	7.95	47.96	Peak	68.2	Pass
NVNT	ac160	5250	-65.15	-67.04	7.95	32.25	Average	54	Pass
NVNT	ac160	5250	-54.67	-47.79	7.95	48.25	Peak	68.2	Pass
NVNT	ac160	5250	-65.15	-65.83	7.95	32.76	Average	54	Pass
NVNT	ac160	5250	-56.64	-59.94	7.95	40.26	Peak	68.2	Pass
NVNT	ac160	5250	-67.53	-67.03	7.95	30.97	Average	54	Pass
NVNT	ac160	5250	-59.55	-59.81	7.95	38.56	Peak	68.2	Pass
NVNT	ac160	5250	-68.76	-68.58	7.95	29.57	Average	54	Pass
NVNT	ac160	5250	-53.45	-53.7	7.95	44.67	Peak	68.2	Pass
NVNT	ac160	5250	-64.97	-65.28	7.95	33.12	Average	54	Pass
NVNT	ac160	5250	-57.76	-56.91	7.95	40.93	Peak	68.2	Pass
NVNT	ac160	5250	-66.05	-66.24	7.95	32.1	Average	54	Pass
NVNT	ax160	5250	-59.35	-58.25	7.95	39.48	Peak	68.2	Pass
NVNT	ax160	5250	-66.4	-66.91	7.95	31.59	Average	54	Pass
NVNT	ax160	5250	-54.74	-55.01	7.95	43.37	Peak	68.2	Pass
NVNT	ax160	5250	-65.82	-65.55	7.95	32.56	Average	54	Pass
NVNT	ax160	5250	-60.04	-58.61	7.95	38.97	Peak	68.2	Pass
NVNT	ax160	5250	-67.64	-67.47	7.95	30.69	Average	54	Pass
NVNT	ax160	5250	-60.01	-60.27	7.95	38.1	Peak	68.2	Pass
NVNT	ax160	5250	-68.4	-68.95	7.95	29.57	Average	54	Pass
NVNT	ax160	5250	-54.52	-54.66	7.95	43.65	Peak	68.2	Pass
NVNT	ax160	5250	-65	-65.63	7.95	32.94	Average	54	Pass
NVNT	ax160	5250	-57.6	-58.01	7.95	40.44	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



NVNT	ax160	5250	-65.77	-66.5	7.95	32.12	Average	54	Pass
------	-------	------	--------	-------	------	-------	---------	----	------



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



B.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant1	5240	0	0	25	Pass
NVNT	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
NVNT	n40	5190	Ant1	5190	0	0	25	Pass
NVNT	n40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac20	5180	Ant1	5180	0	0	25	Pass
NVNT	ac20	5200	Ant1	5200	0	0	25	Pass
NVNT	ac20	5240	Ant1	5240	0	0	25	Pass
NVNT	ac40	5190	Ant1	5190	0	0	25	Pass
NVNT	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
NVNT	ax20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
NVNT	ax20	5200	Ant1	5200	0	0	25	Pass
NVNT	ax20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant1	5190	0	0	25	Pass
NVNT	ax40	5230	Ant1	5230	0	0	25	Pass
NVNT	ax80	5210	Ant1	5210	0	0	25	Pass
NVNT	ac160	5250	Ant1	5250	0	0	25	Pass
NVNT	ax160	5250	Ant1	5250	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant1

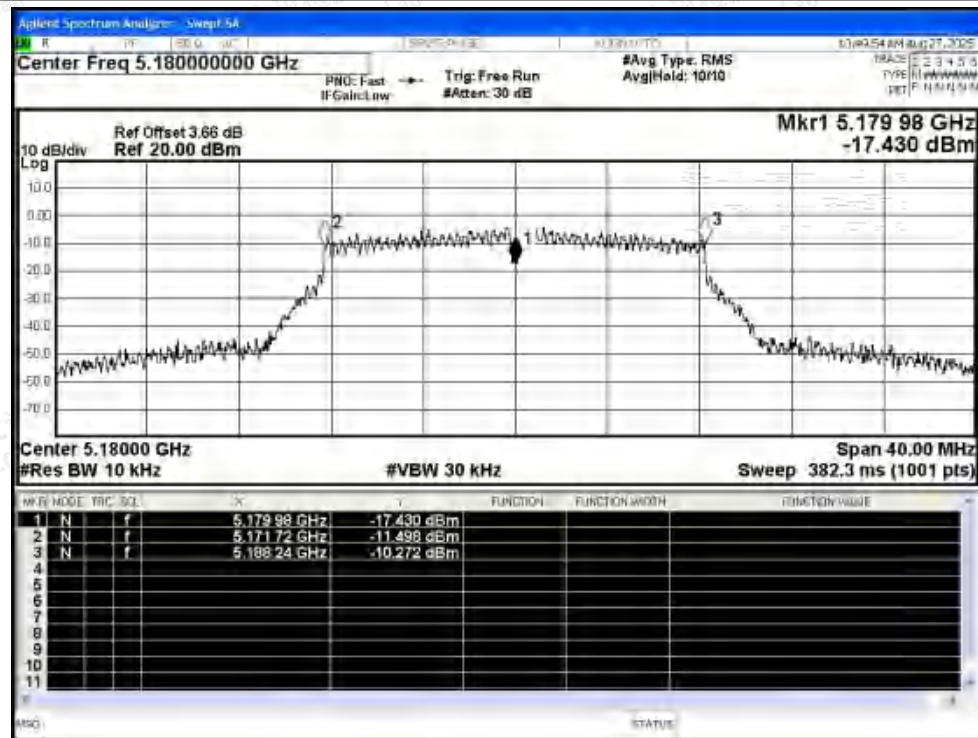

Freq. Stability NVNT a 5200MHz Ant1

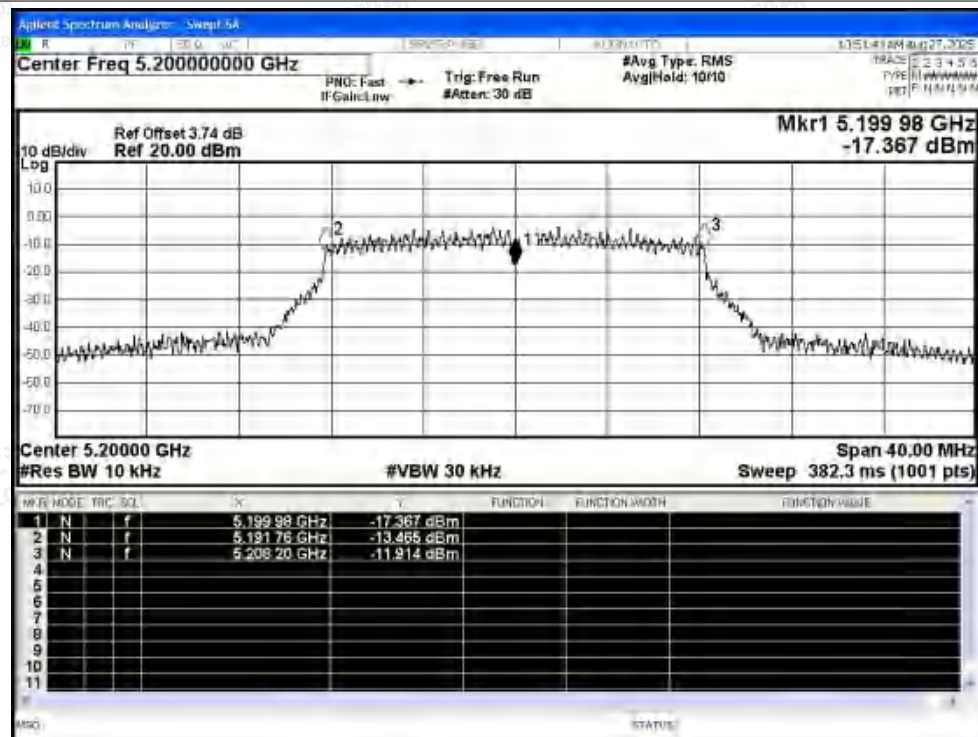


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant1

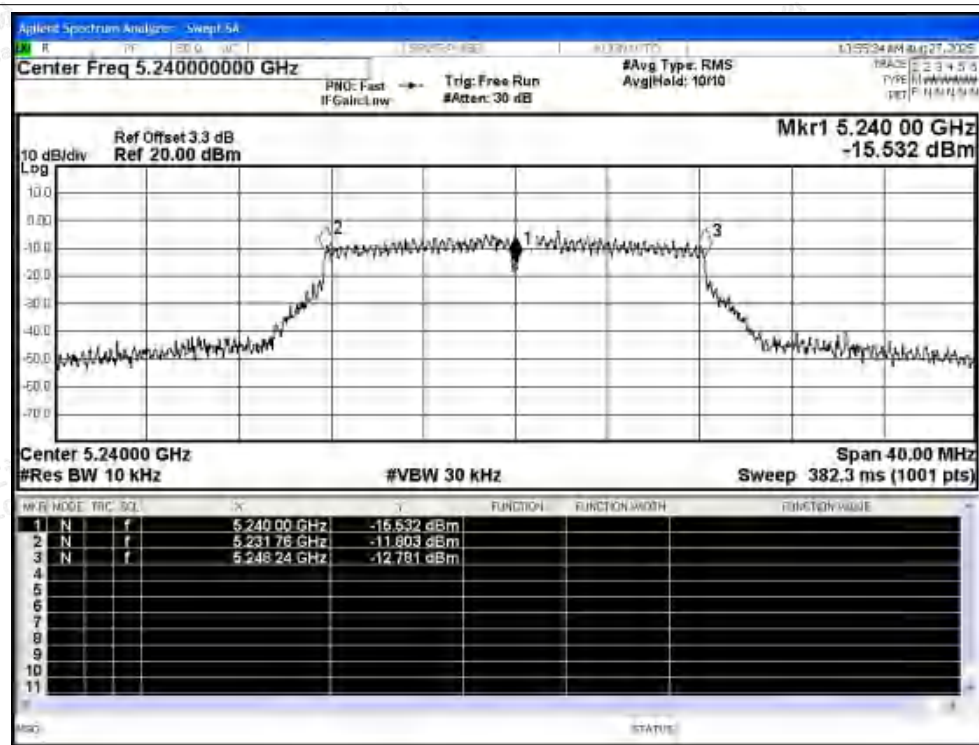

Freq. Stability NVNT n20 5180MHz Ant1

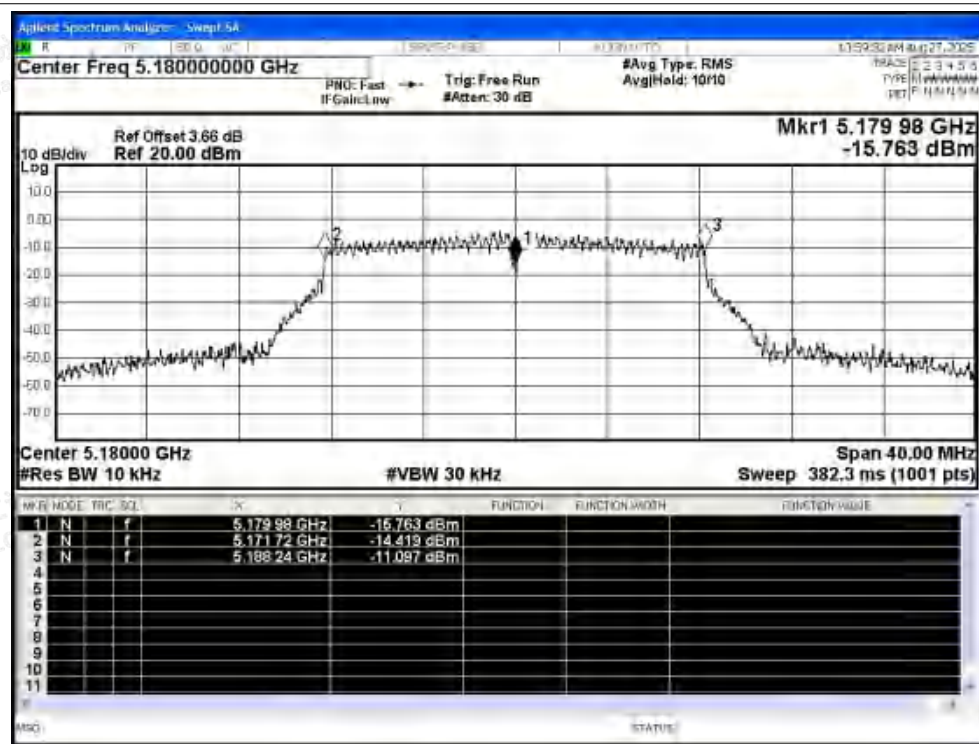

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant1

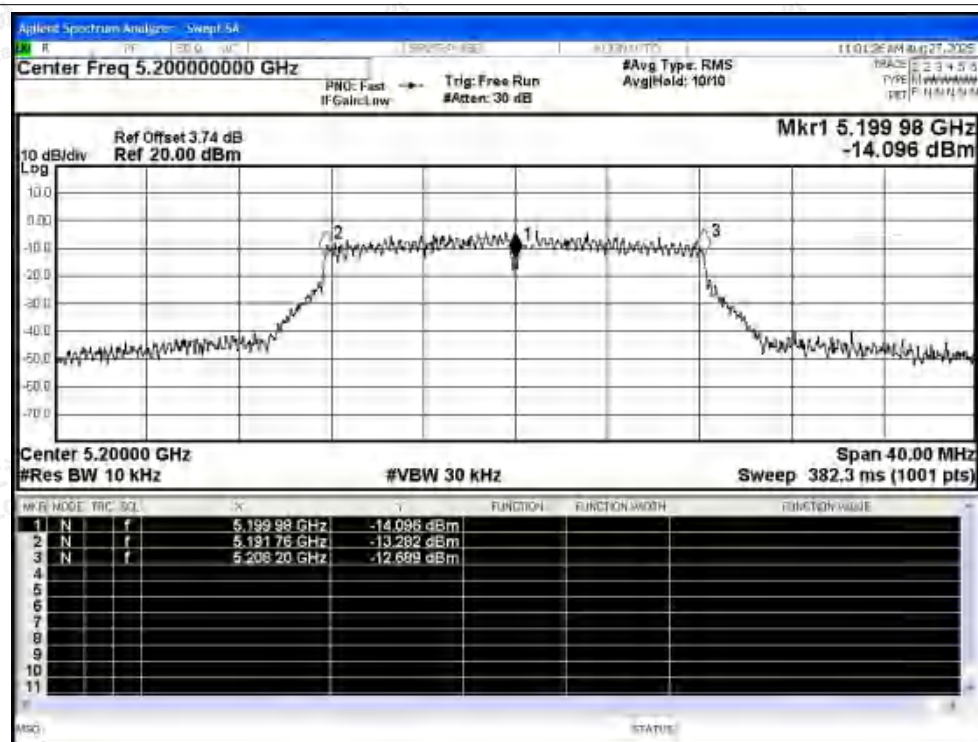


Freq. Stability NVNT n20 5240MHz Ant1

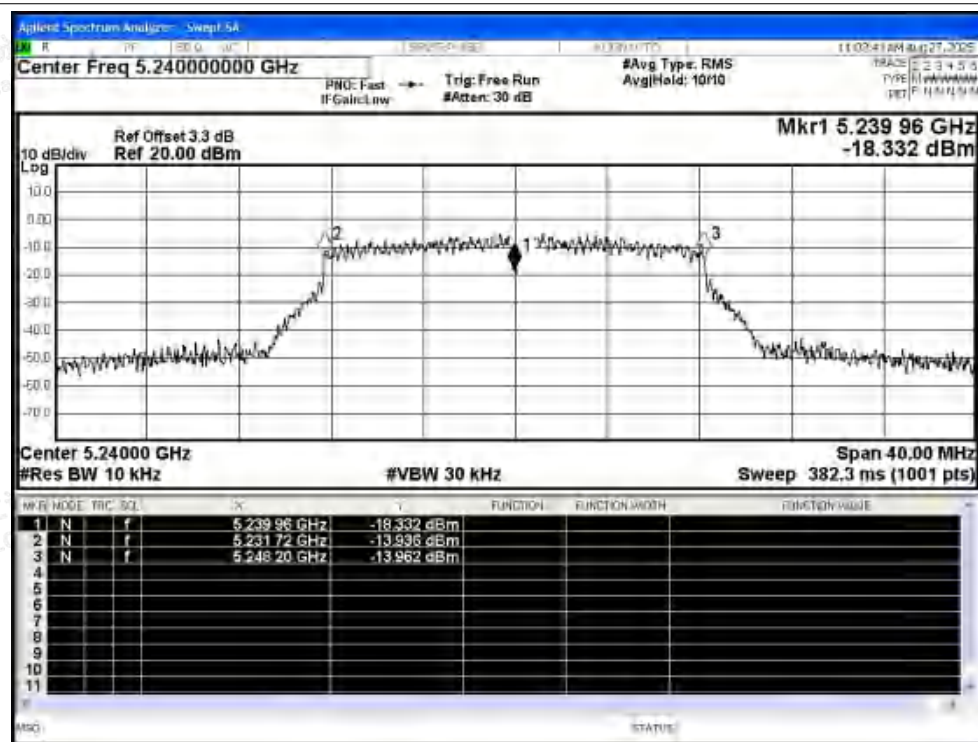




Freq. Stability NVNT n40 5190MHz Ant1

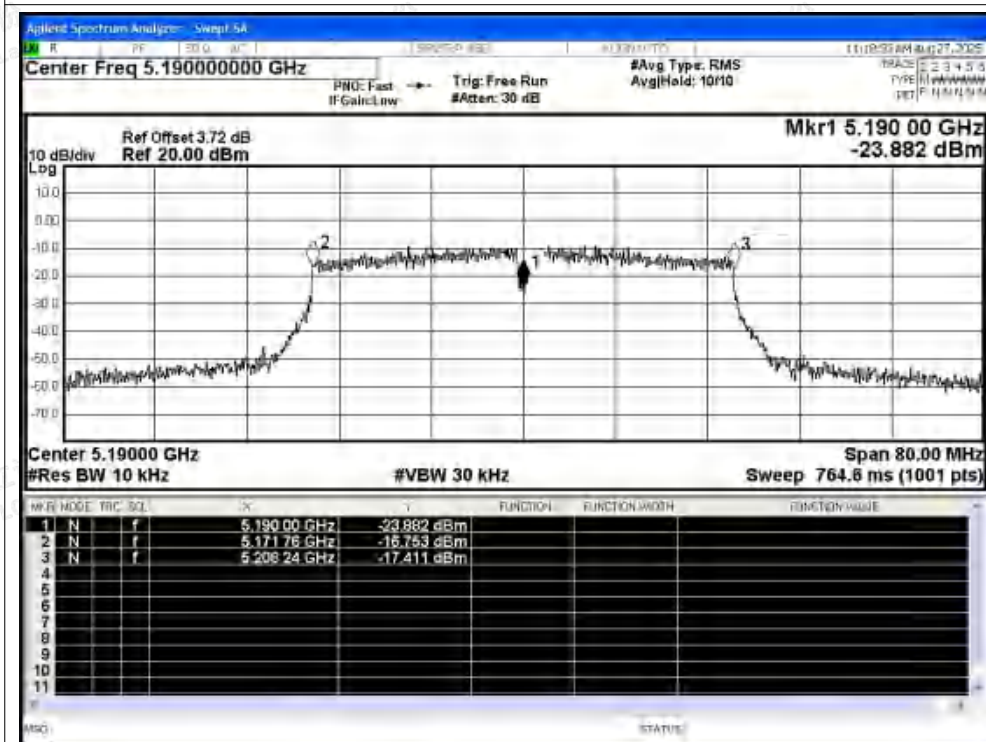


Freq. Stability NVNT n40 5230MHz Ant1

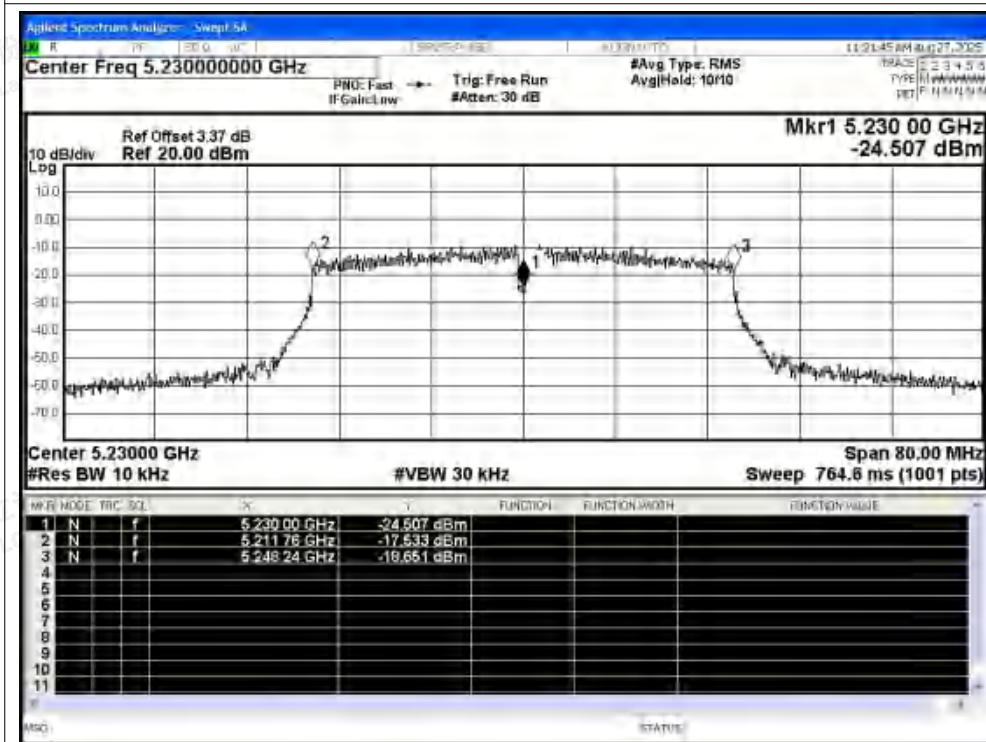




Freq. Stability NVNT ac20 5180MHz Ant1

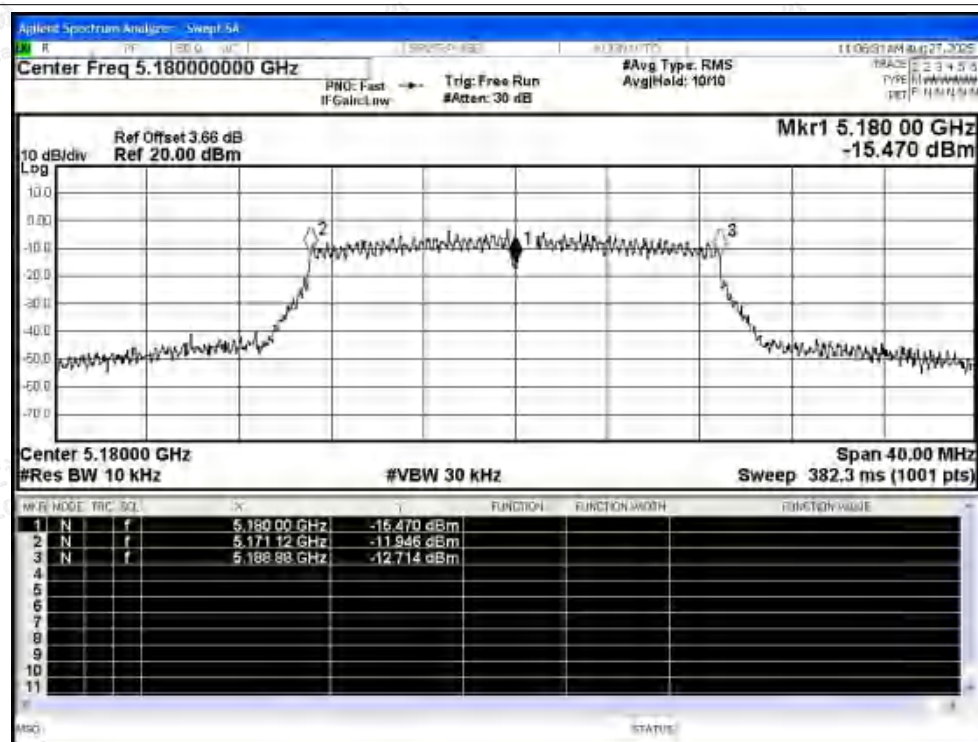


Freq. Stability NVNT ac20 5200MHz Ant1

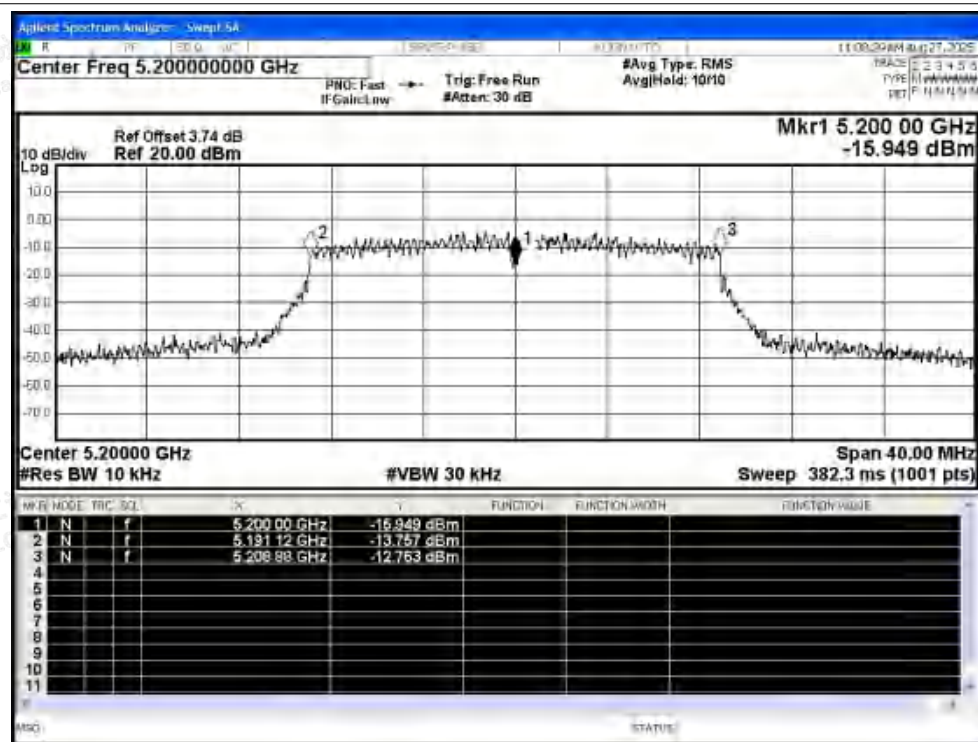




Freq. Stability NVNT ac20 5240MHz Ant1

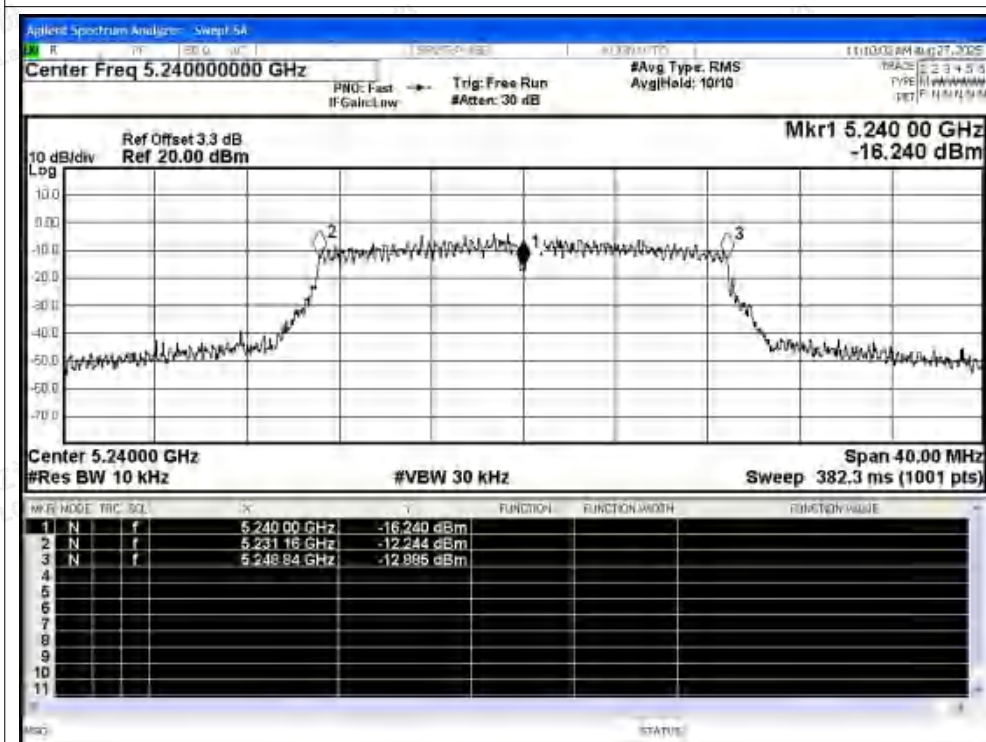

Freq. Stability NVNT ac40 5190MHz Ant1

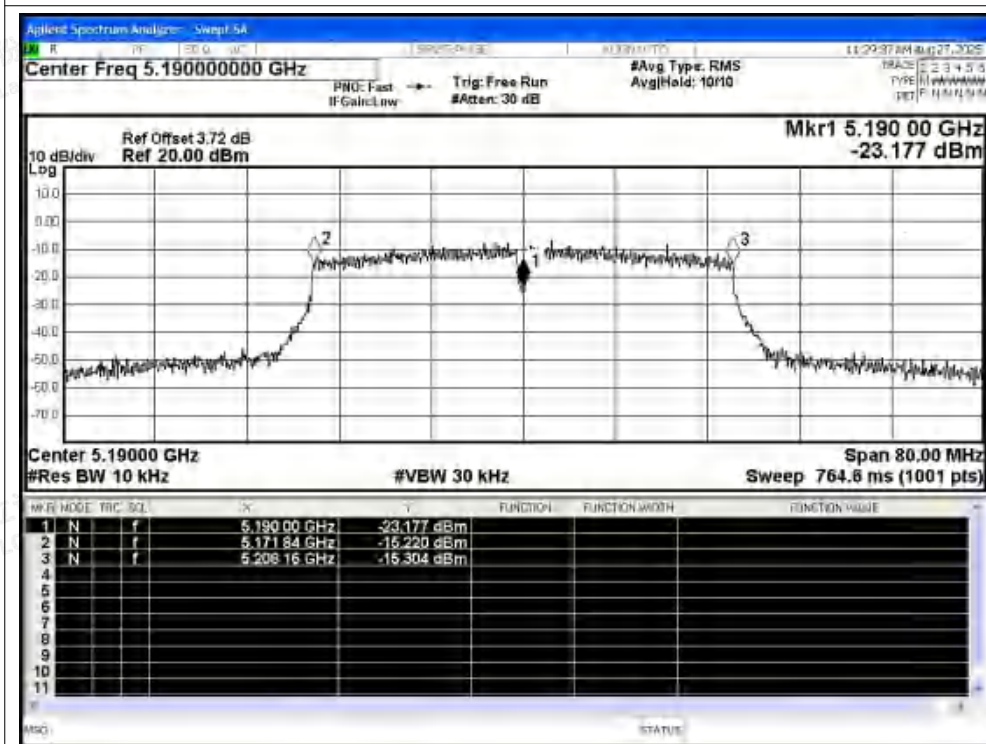

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant1

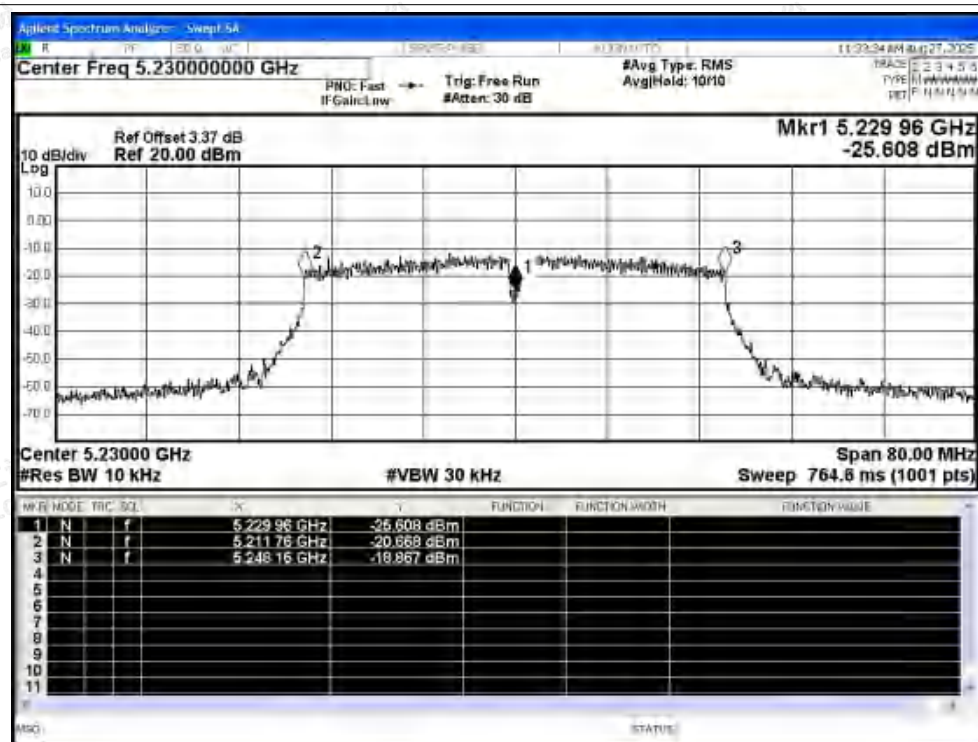


Freq. Stability NVNT ac80 5210MHz Ant1

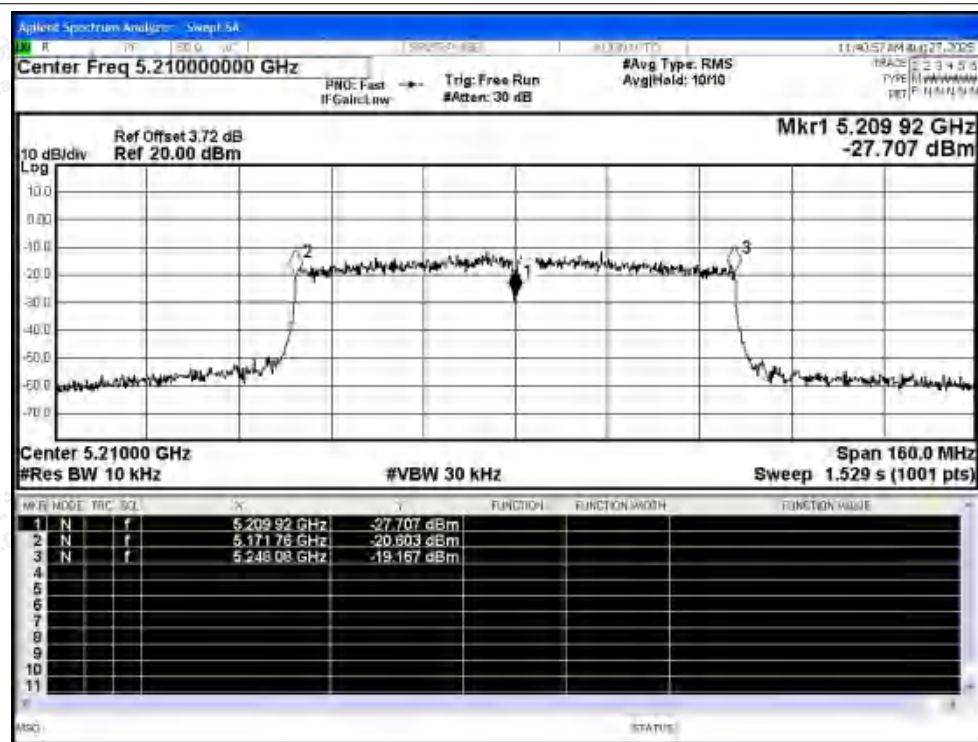




Freq. Stability NVNT ax20 5180MHz Ant1

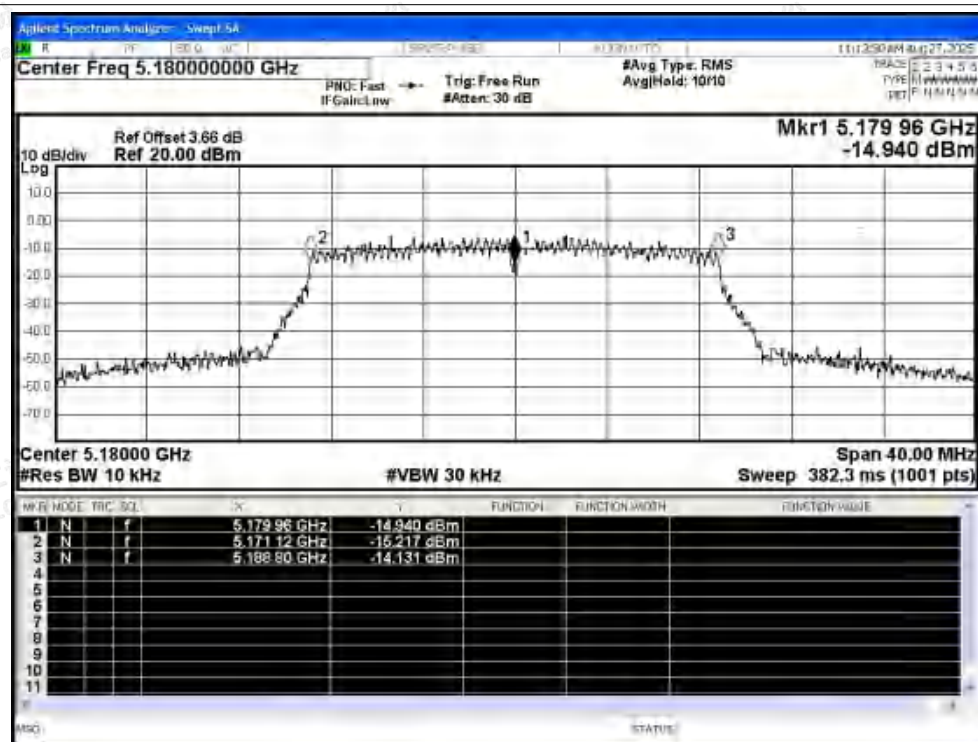

Freq. Stability NVNT ax20 5200MHz Ant1

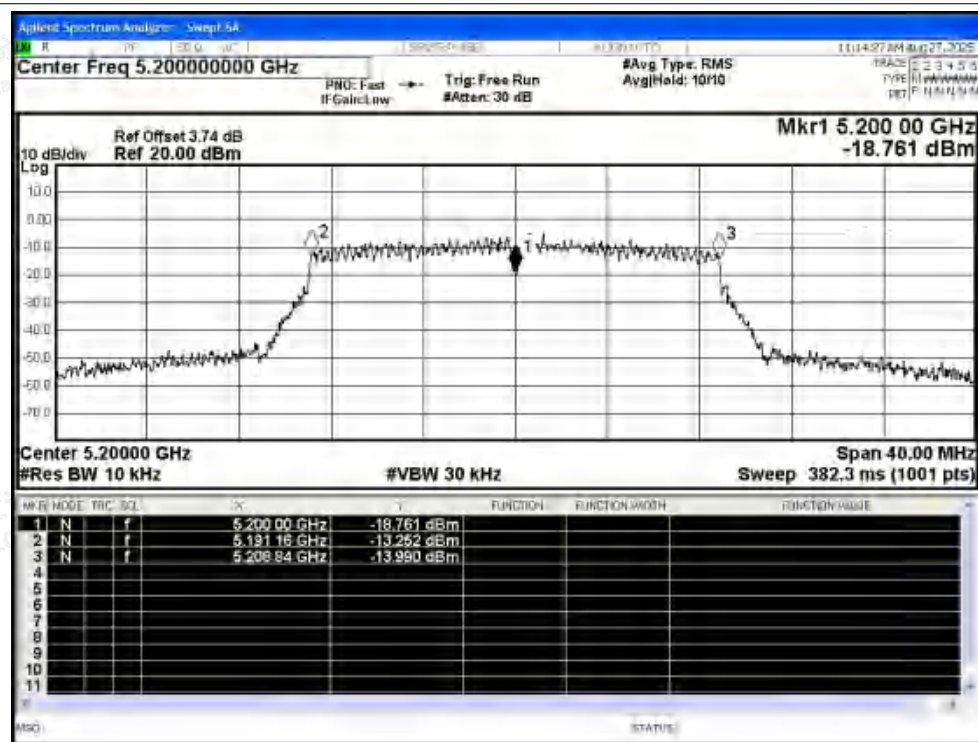


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant1

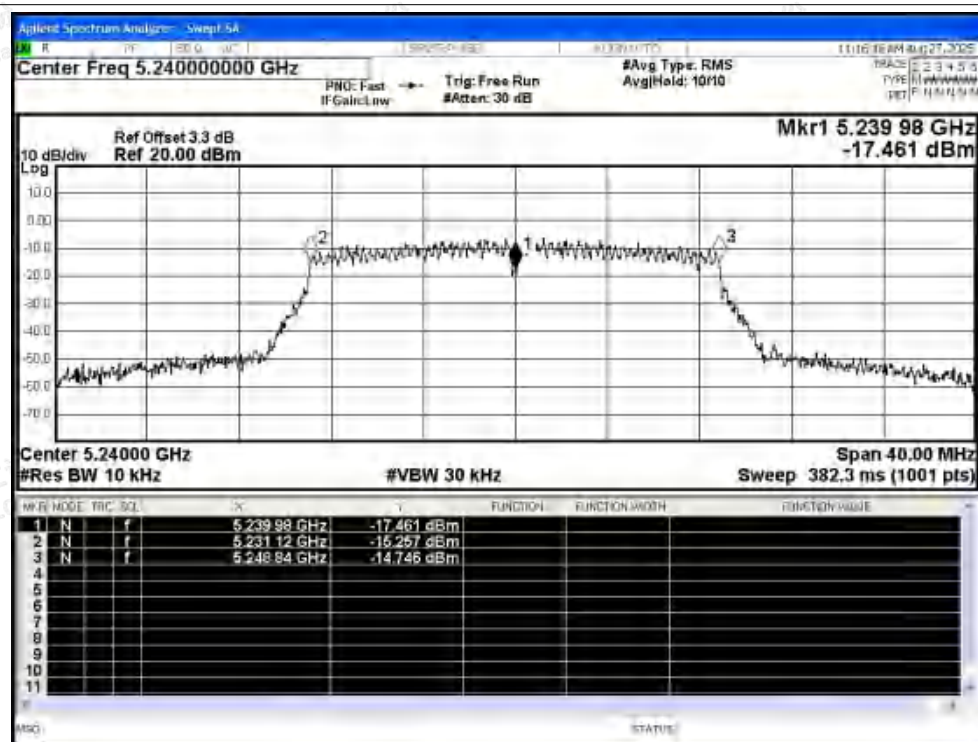

Freq. Stability NVNT ax40 5190MHz Ant1

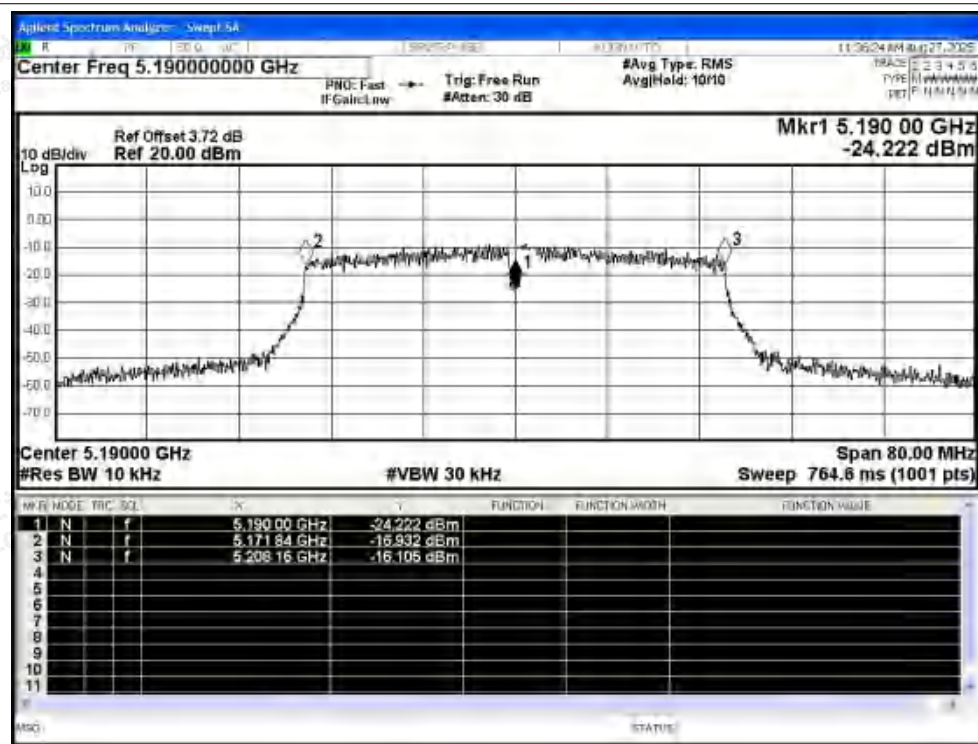

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Freq. Stability NVNT ax40 5230MHz Ant1

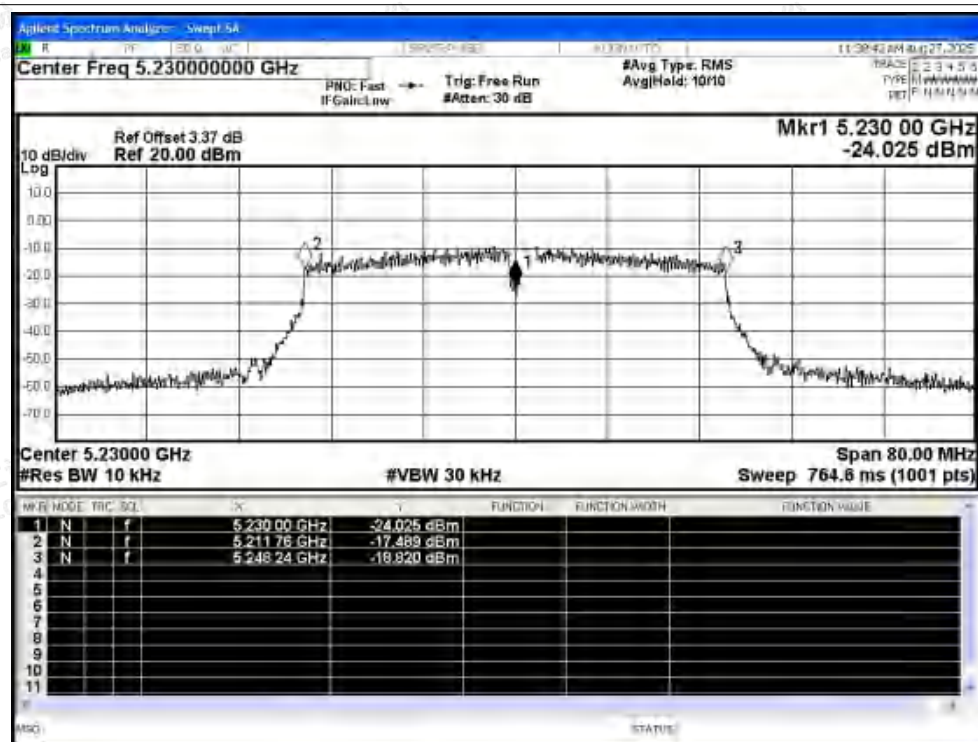


Freq. Stability NVNT ax80 5210MHz Ant1

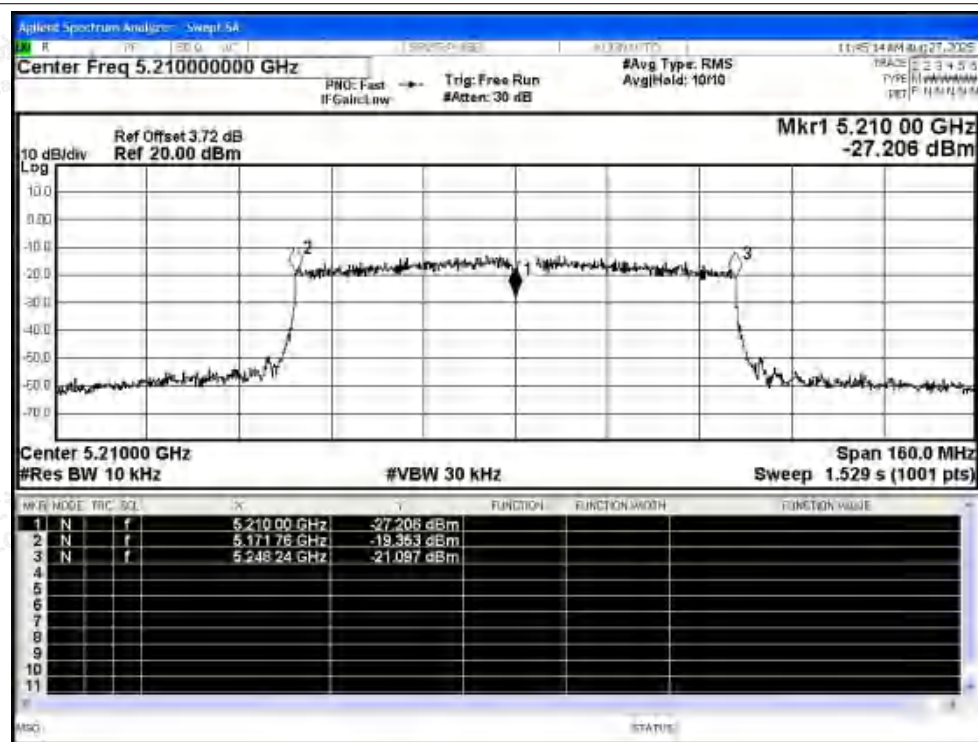




Freq. Stability NVNT ac160 5250MHz Ant1

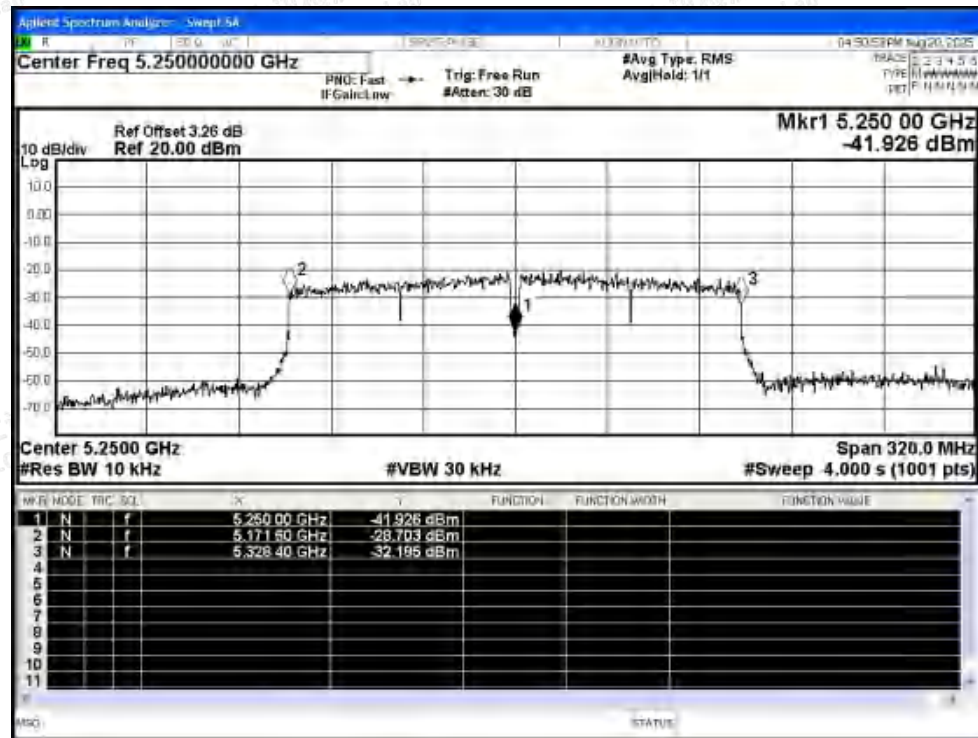

Freq. Stability NVNT ax160 5250MHz Ant1

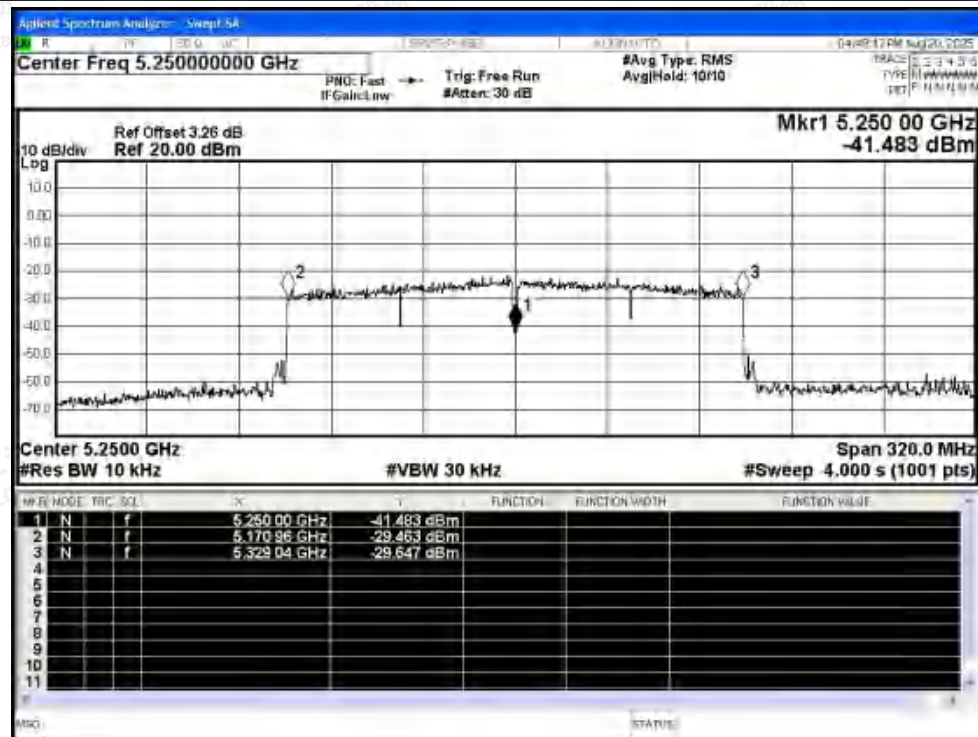


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant2	5240	0	0	25	Pass
NVNT	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant2	5200	0	0	25	Pass
NVNT	n20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
NVNT	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass
NVNT	ax20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant2	5240	0	0	25	Pass
NVNT	ax40	5190	Ant2	5190	0	0	25	Pass
NVNT	ax40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
NVNT	ax80	5210	Ant2	5210	0	0	25	Pass
NVNT	ac160	5250	Ant2	5250	0	0	25	Pass
NVNT	ax160	5250	Ant2	5250	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant2

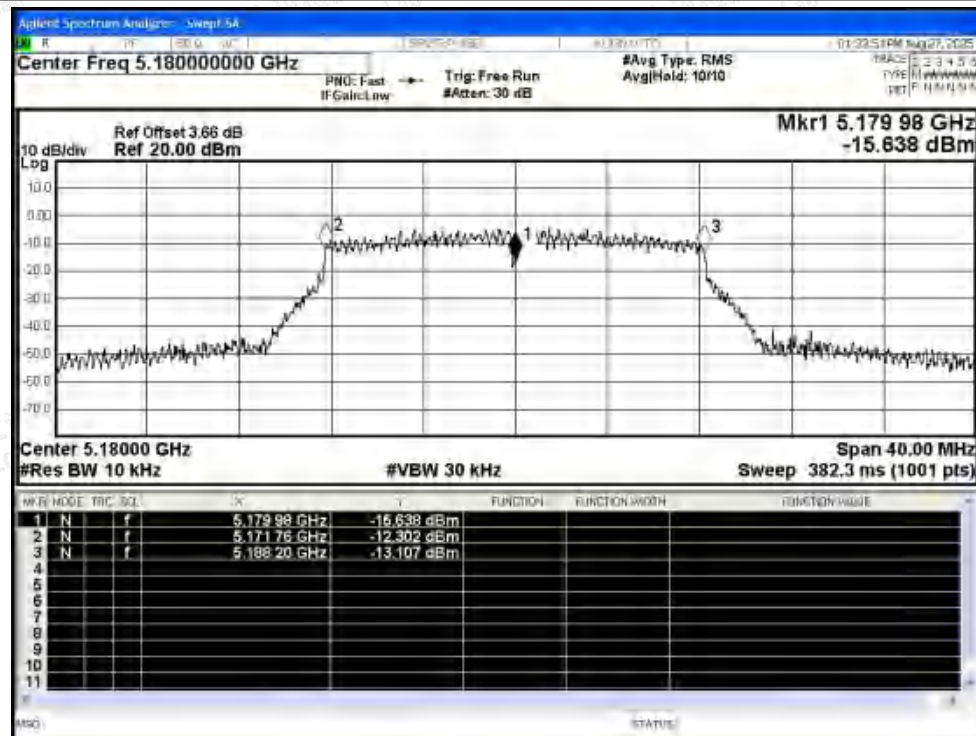

Freq. Stability NVNT a 5200MHz Ant2

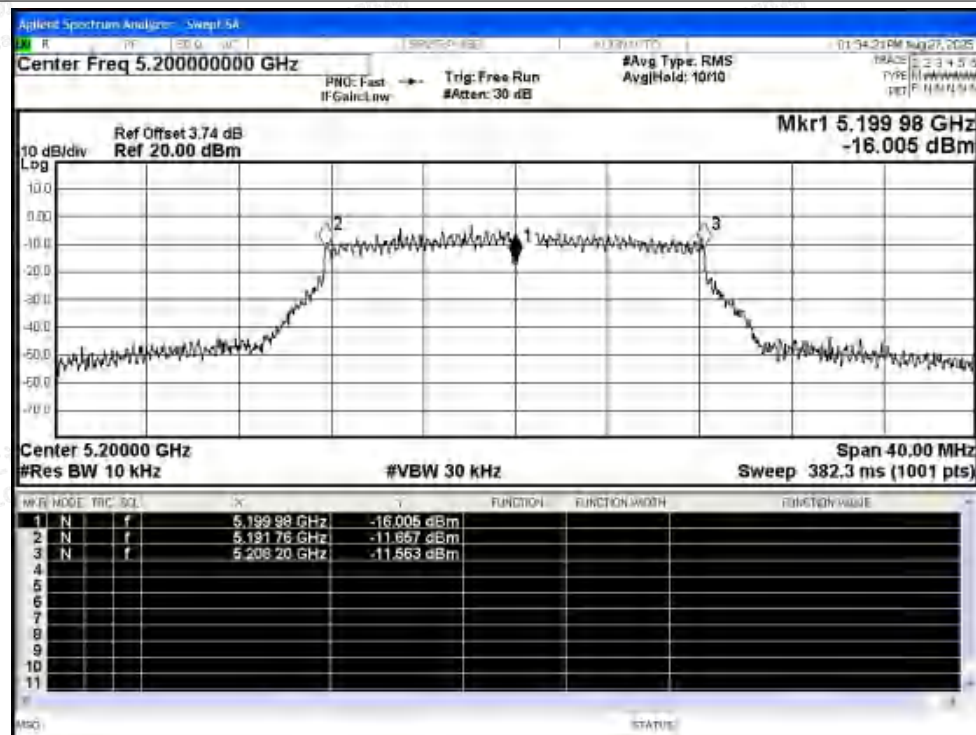

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant2

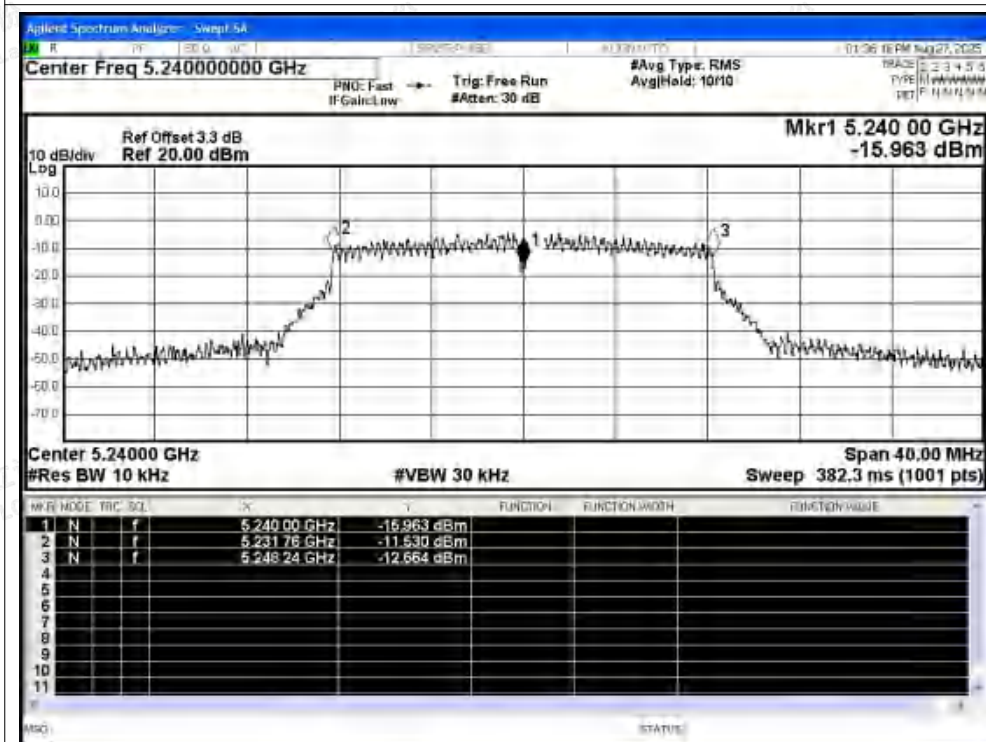

Freq. Stability NVNT n20 5180MHz Ant2

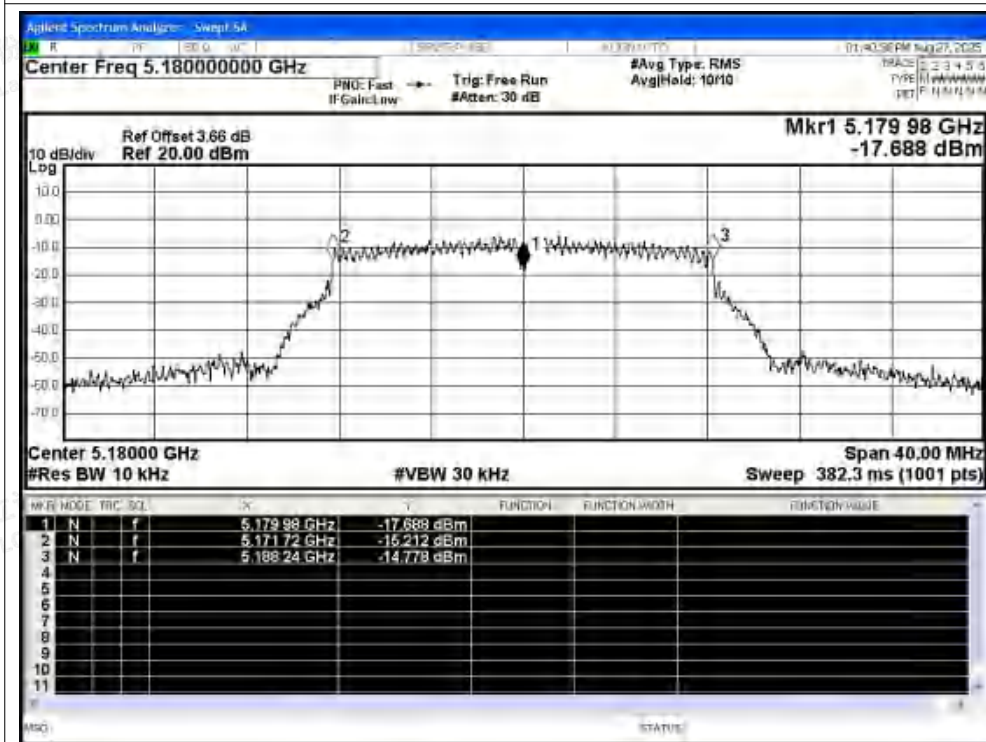

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant2

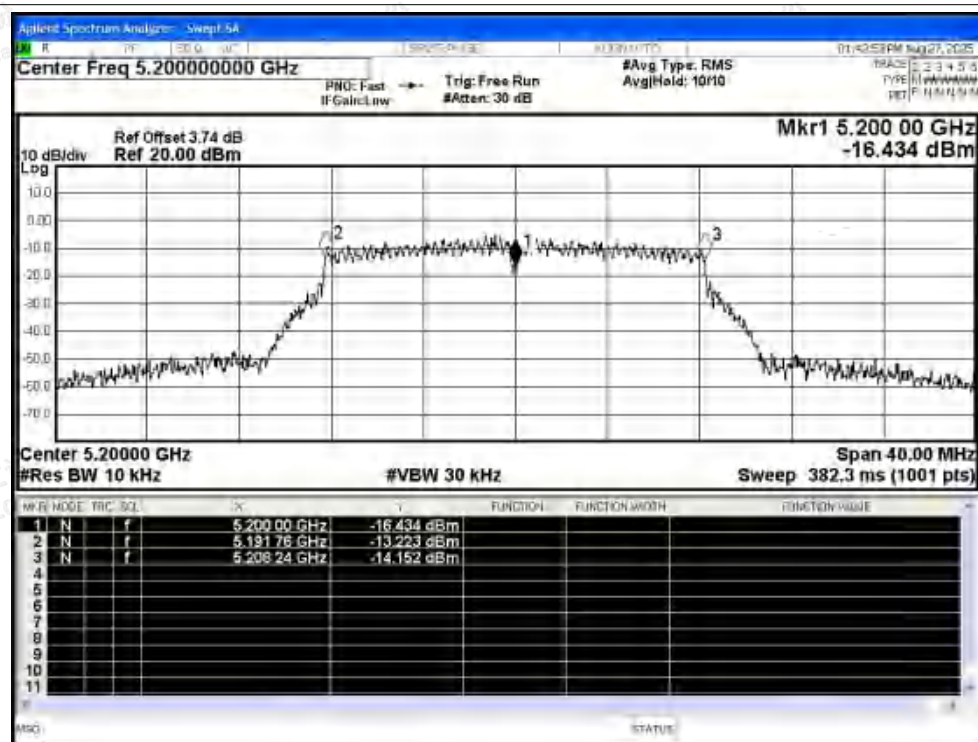

Freq. Stability NVNT n20 5240MHz Ant2

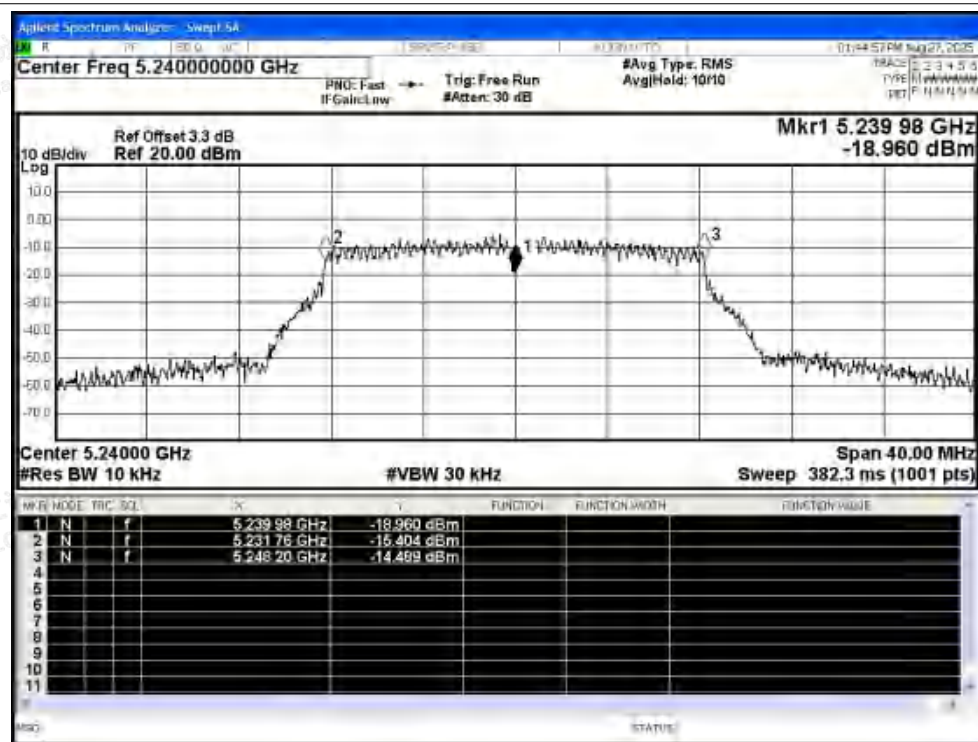

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant2

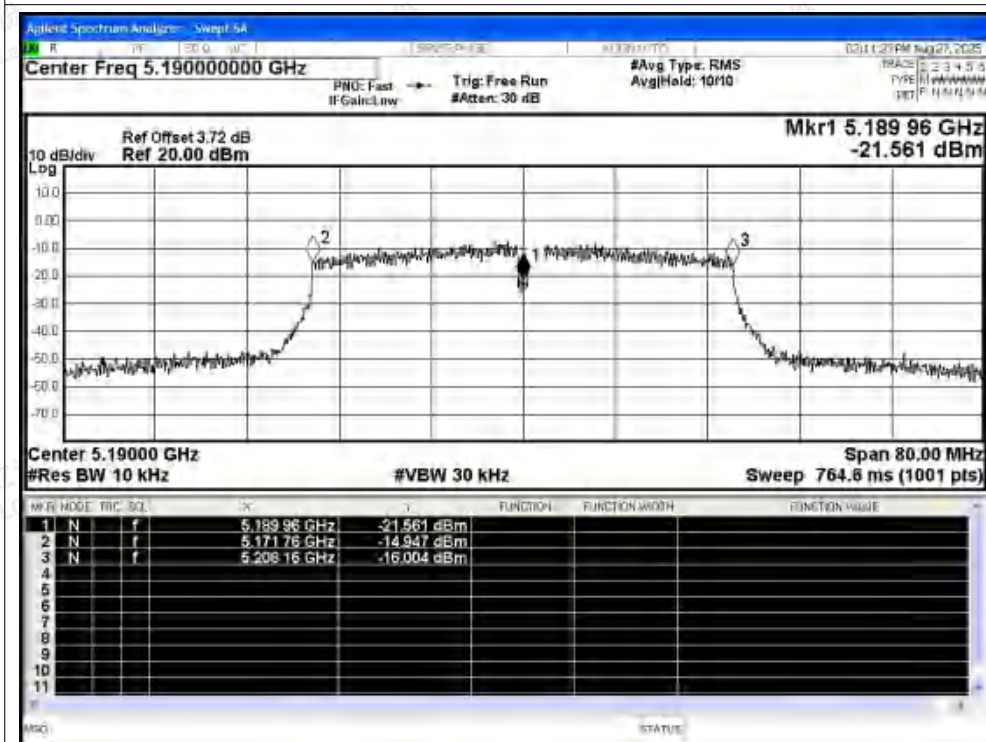


Freq. Stability NVNT n40 5230MHz Ant2

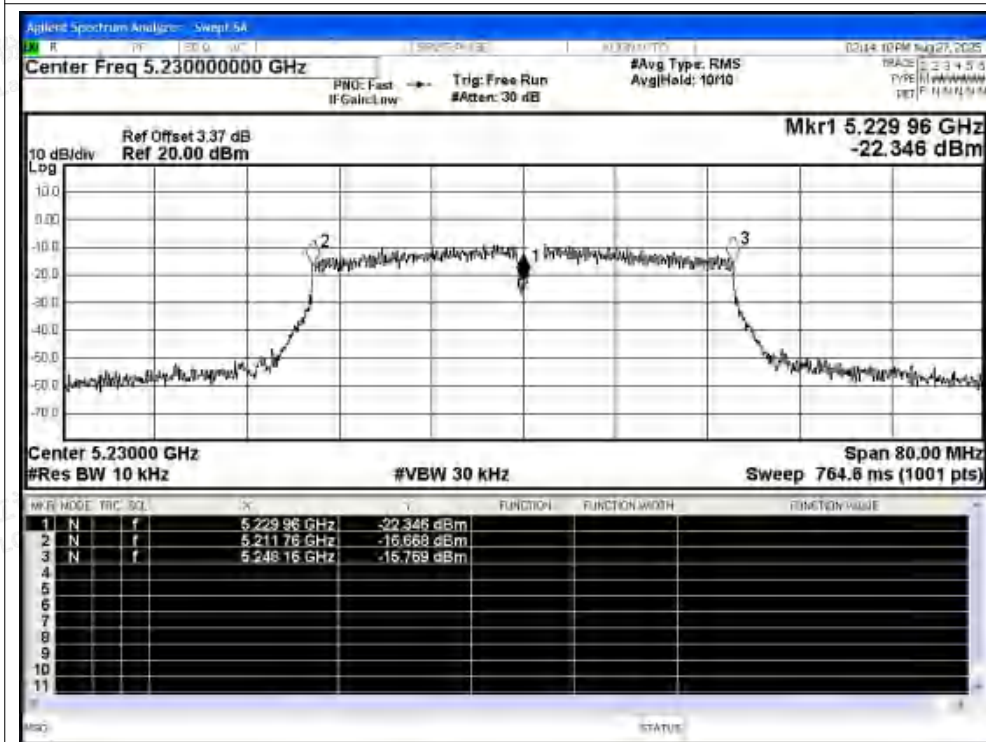




Freq. Stability NVNT ac20 5180MHz Ant2

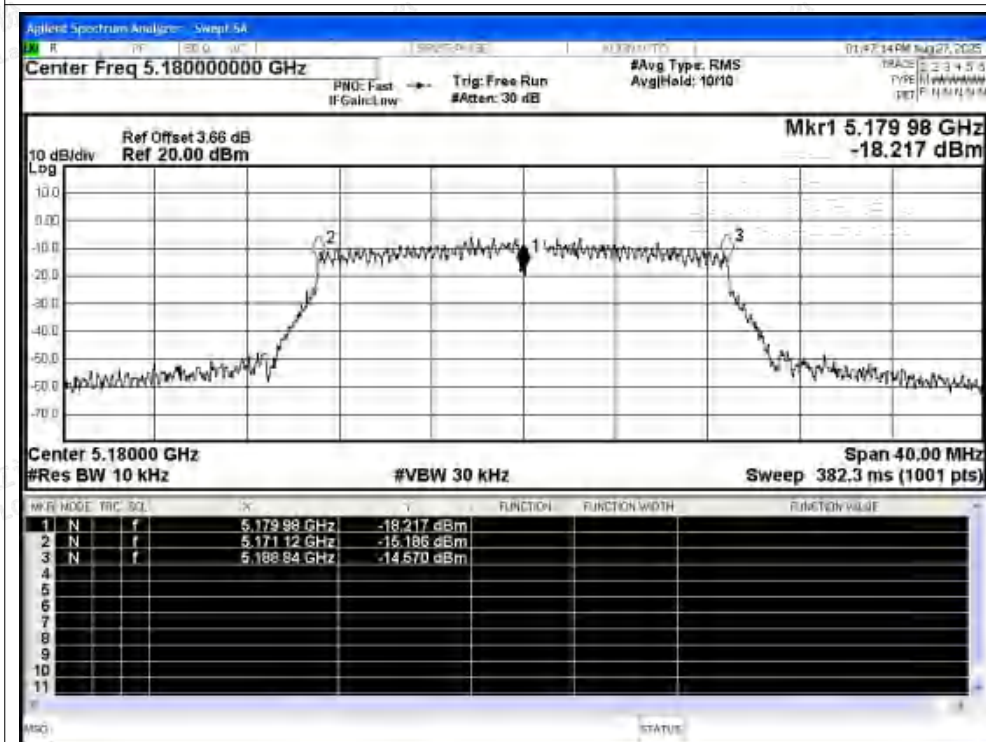

Freq. Stability NVNT ac20 5200MHz Ant2

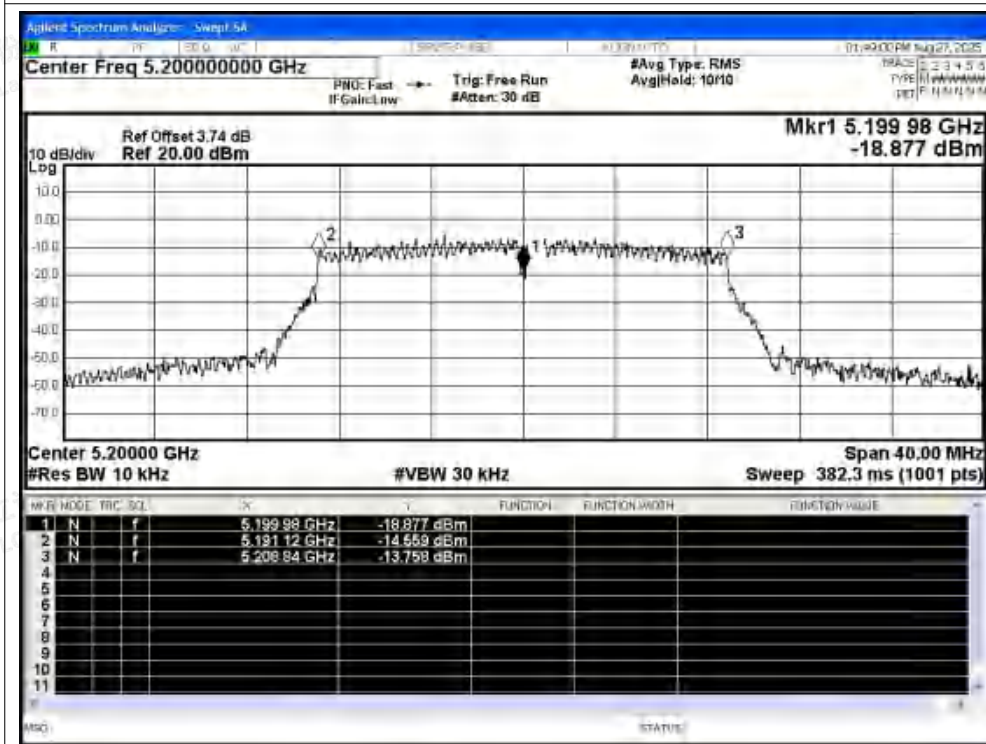

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Freq. Stability NVNT ac20 5240MHz Ant2

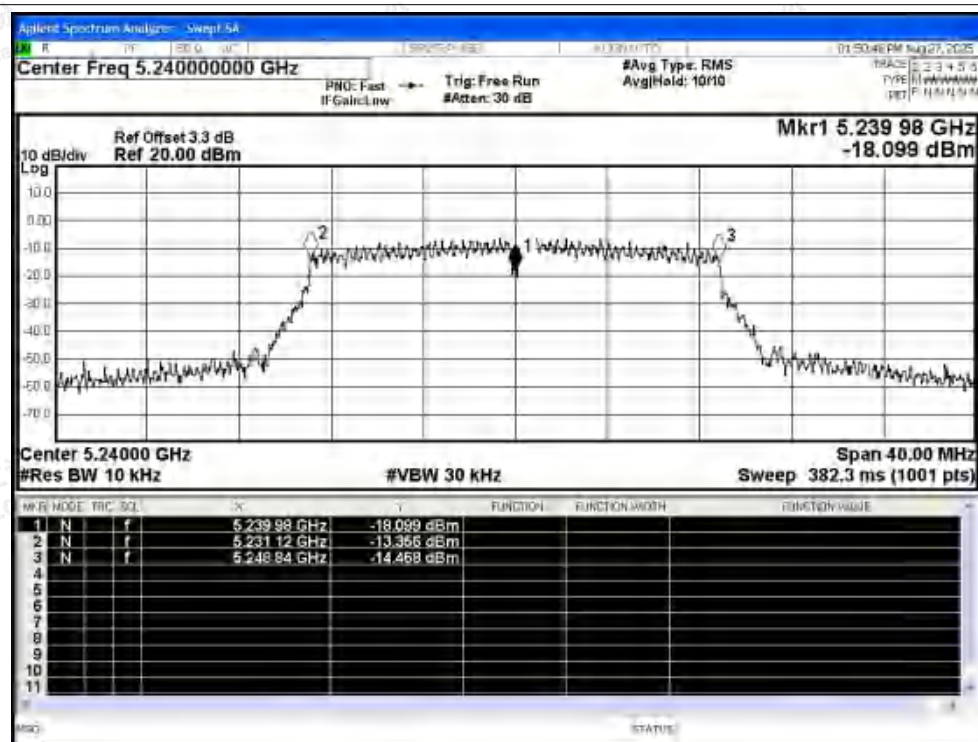


Freq. Stability NVNT ac40 5190MHz Ant2

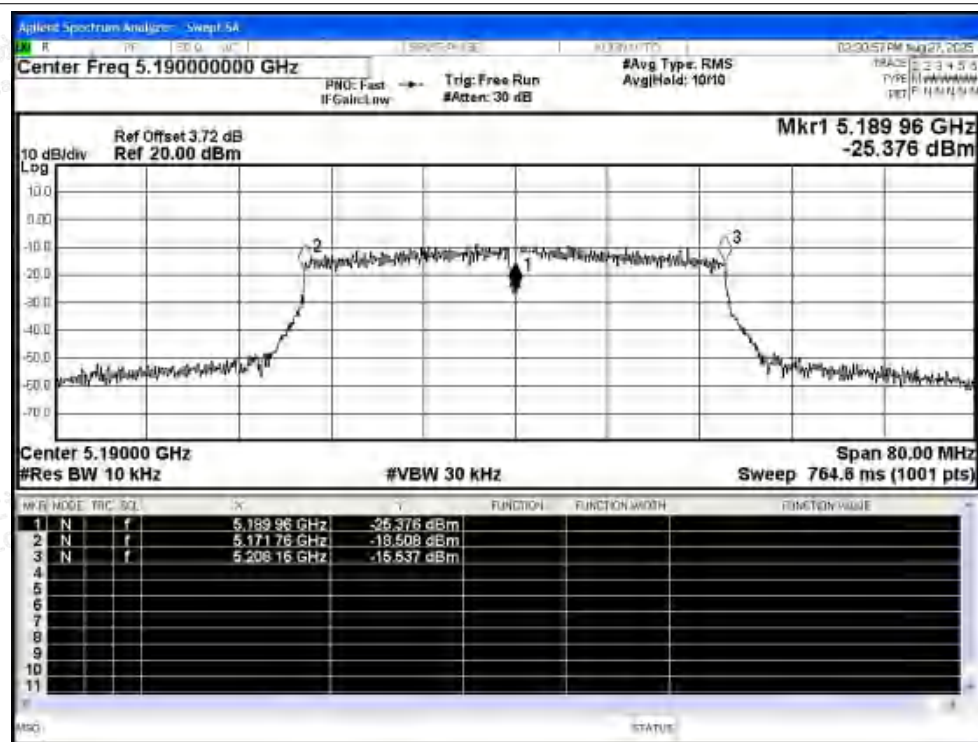




Freq. Stability NVNT ac40 5230MHz Ant2

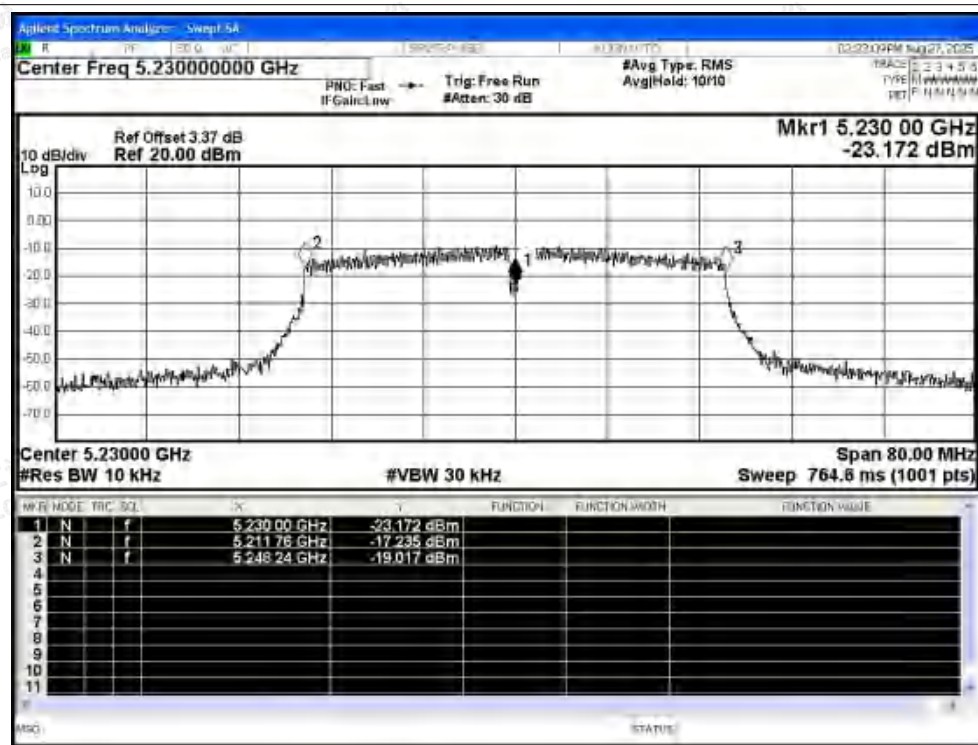

Freq. Stability NVNT ac80 5210MHz Ant2

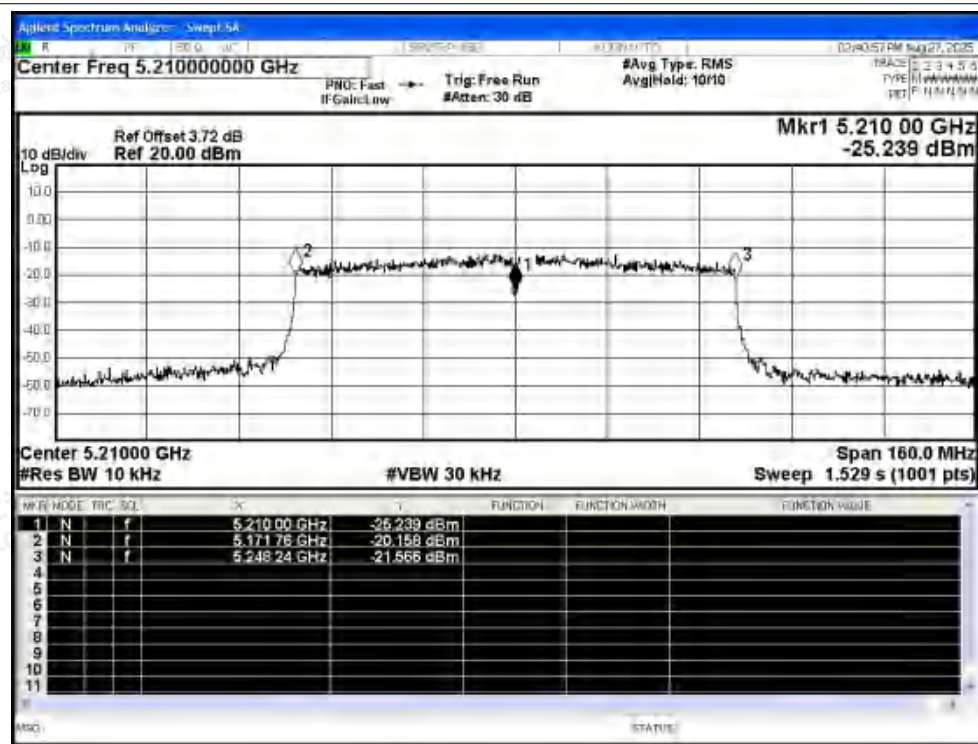

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant2

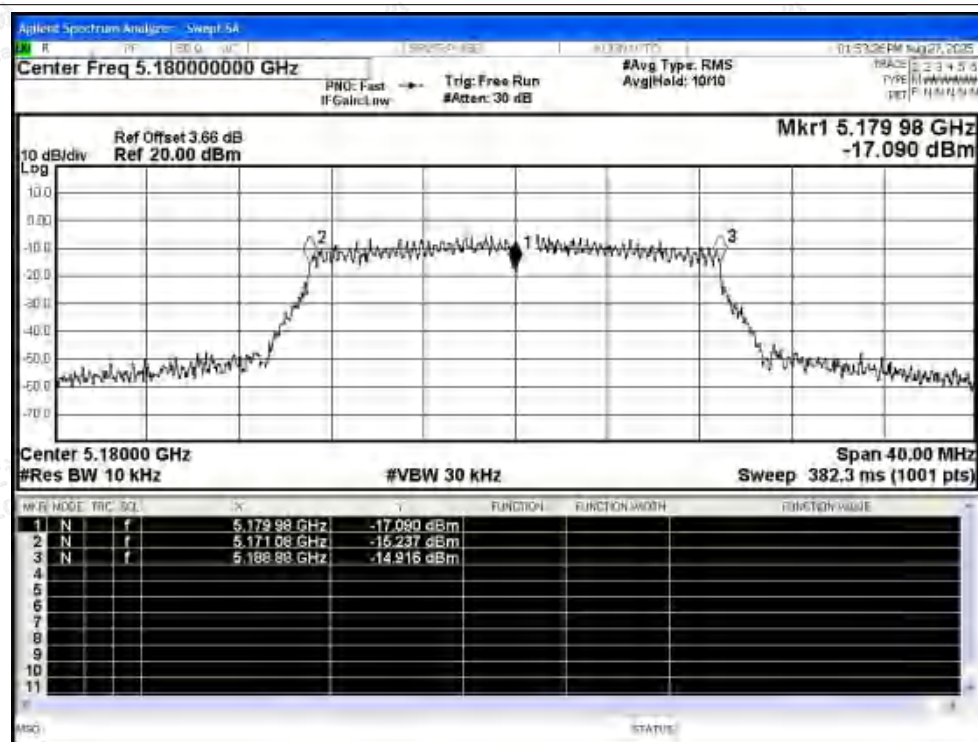

Freq. Stability NVNT ax20 5200MHz Ant2

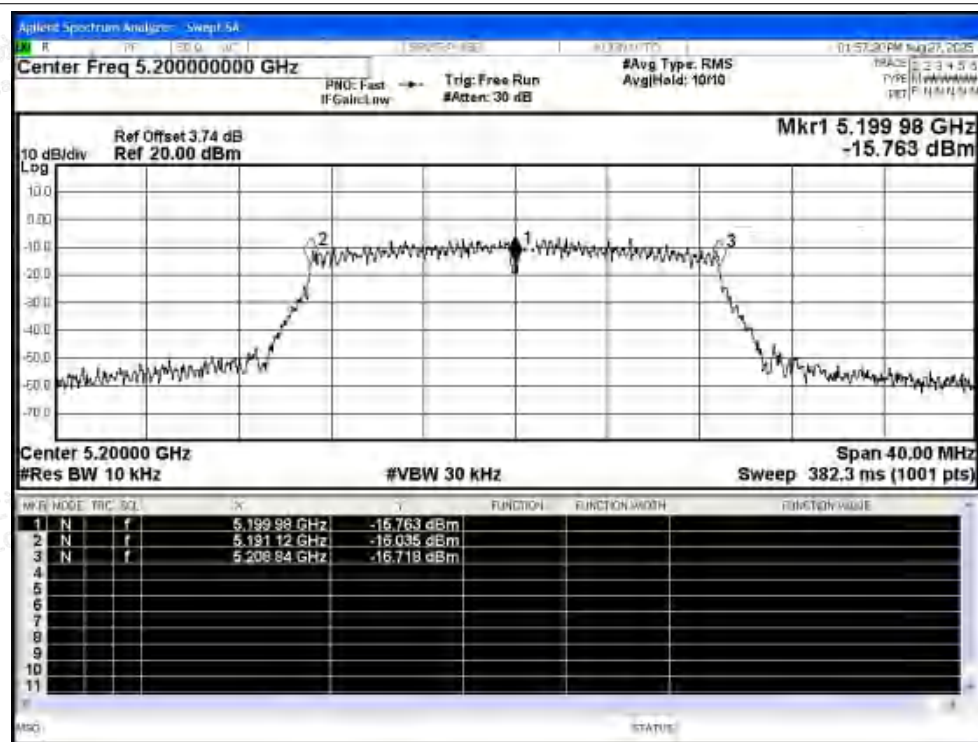

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant2

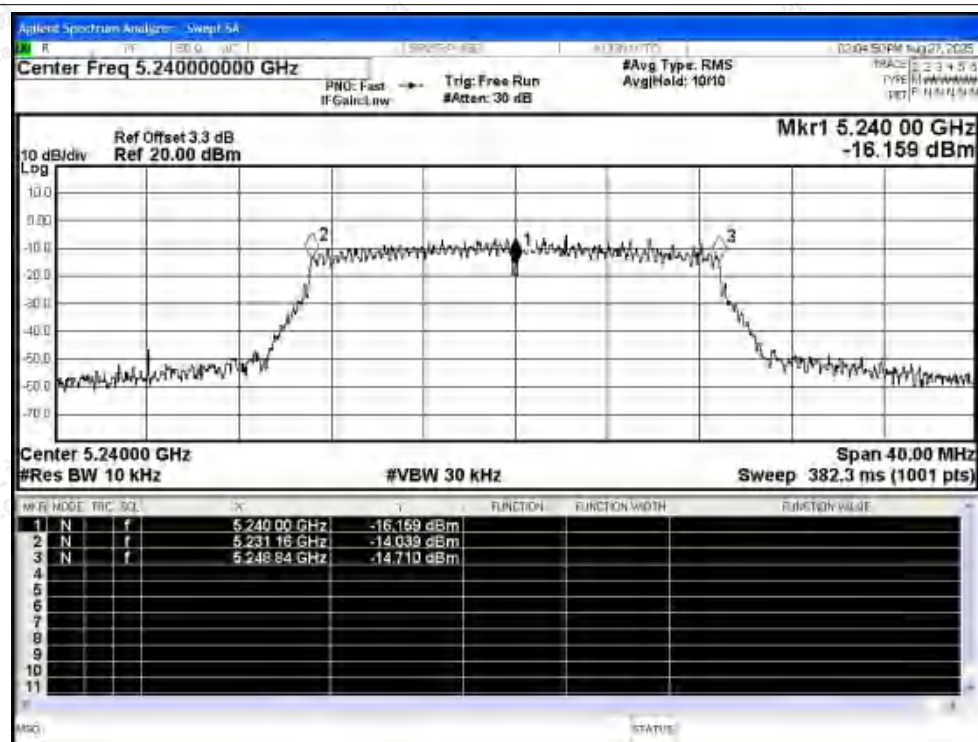


Freq. Stability NVNT ax40 5190MHz Ant2

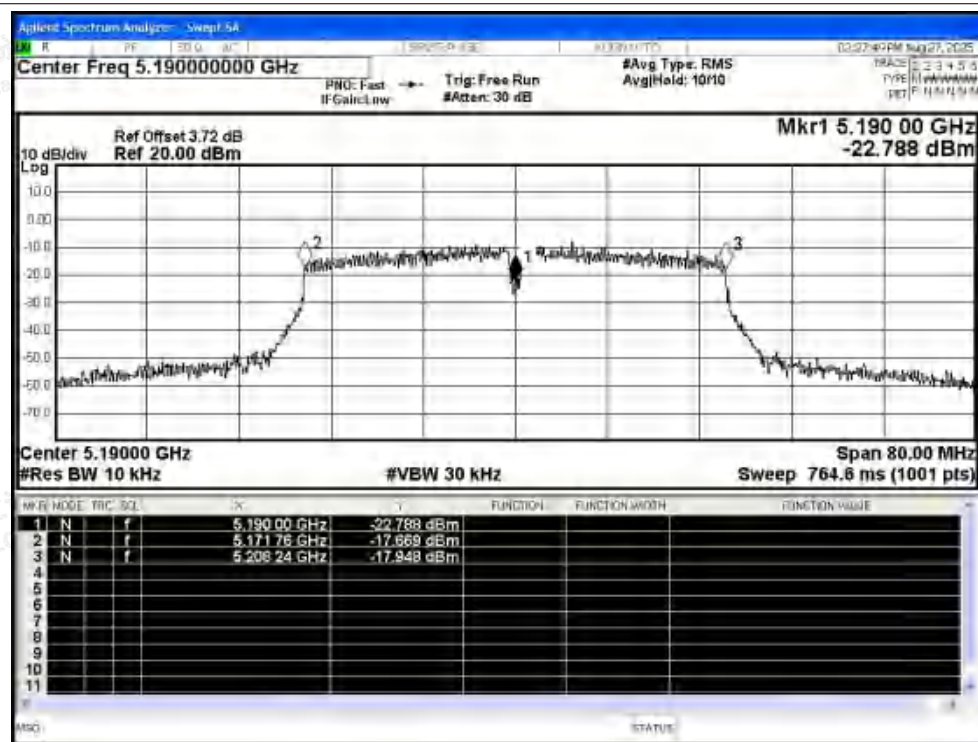




Freq. Stability NVNT ax40 5230MHz Ant2

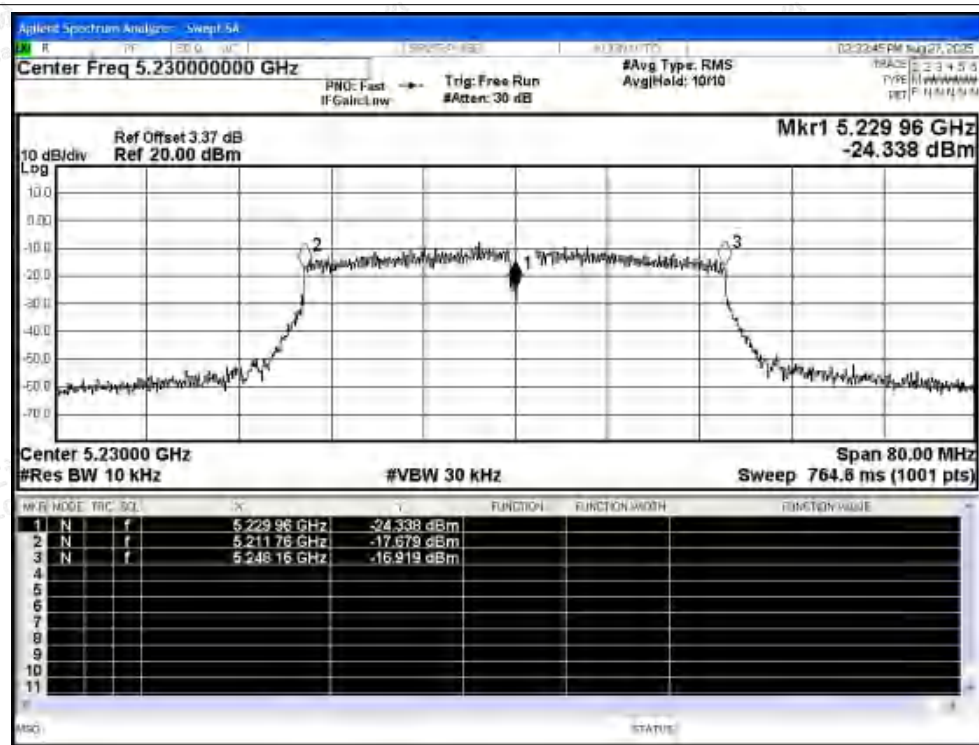

Freq. Stability NVNT ax80 5210MHz Ant2

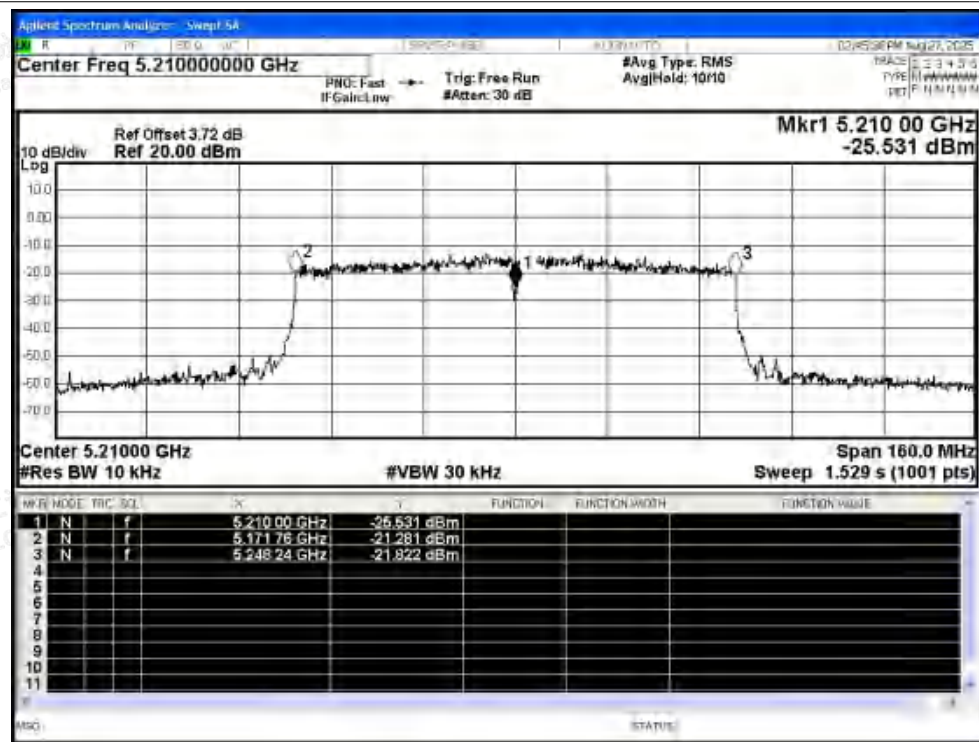


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac160 5250MHz Ant2

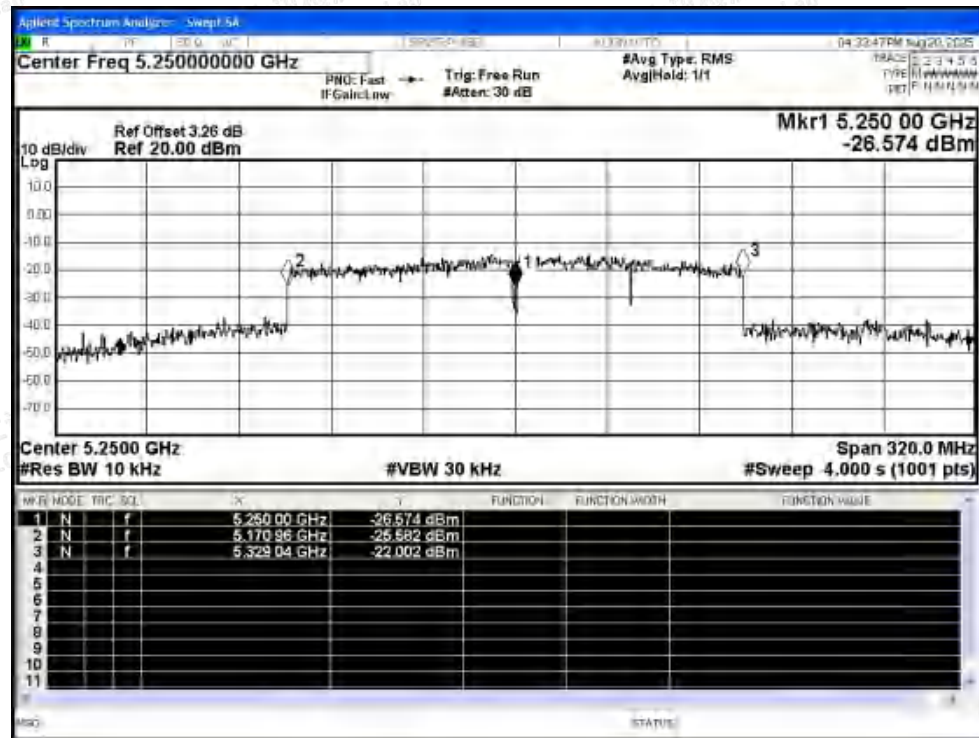

Freq. Stability NVNT ax160 5250MHz Ant2

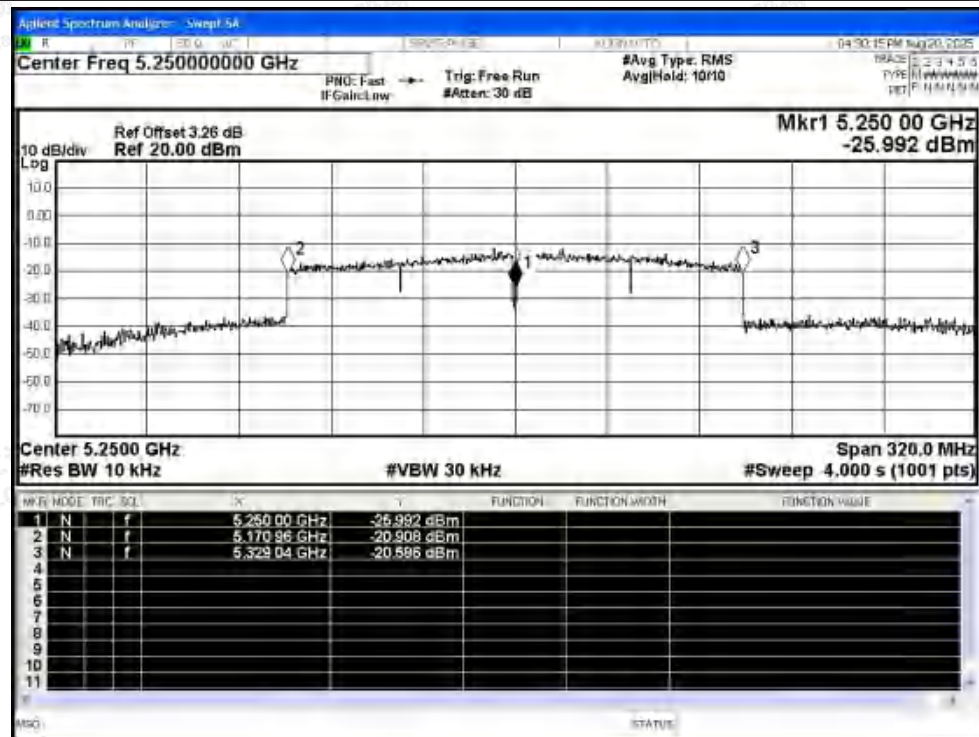

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



B.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	97.48	0.11	0.72
NVNT	a	5200	Ant1	97.55	0.11	0.72
NVNT	a	5240	Ant1	97.55	0.11	0.72
NVNT	n20	5180	Ant1	97.55	0.11	0.72
NVNT	n20	5200	Ant1	97.48	0.11	0.72
NVNT	n20	5240	Ant1	97.48	0.11	0.72
NVNT	n40	5190	Ant1	94.91	0.23	1.53
NVNT	n40	5230	Ant1	95.05	0.22	1.53
NVNT	ac20	5180	Ant1	97.38	0.12	0.77
NVNT	ac20	5200	Ant1	97.38	0.12	0.77
NVNT	ac20	5240	Ant1	97.38	0.12	0.77
NVNT	ac40	5190	Ant1	94.91	0.23	1.53
NVNT	ac40	5230	Ant1	94.91	0.23	1.53
NVNT	ac80	5210	Ant1	90.53	0.43	3.08
NVNT	ax20	5180	Ant1	97.38	0.12	0.77
NVNT	ax20	5200	Ant1	97.31	0.12	0.77
NVNT	ax20	5240	Ant1	97.38	0.12	0.77
NVNT	ax40	5190	Ant1	94.91	0.23	1.53
NVNT	ax40	5230	Ant1	94.91	0.23	1.53
NVNT	ax80	5210	Ant1	90.53	0.43	3.08
NVNT	ac160	5250	Ant1	52.99	2.76	0.71
NVNT	ax160	5250	Ant1	52.42	2.81	0.73



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant1

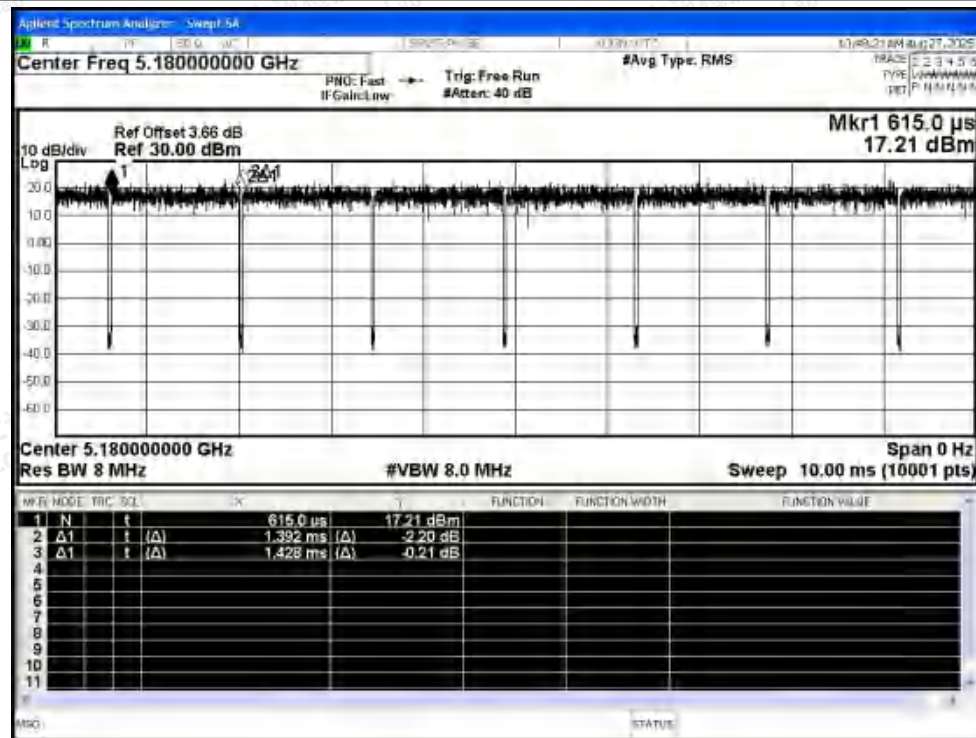

Duty Cycle NVNT a 5200MHz Ant1

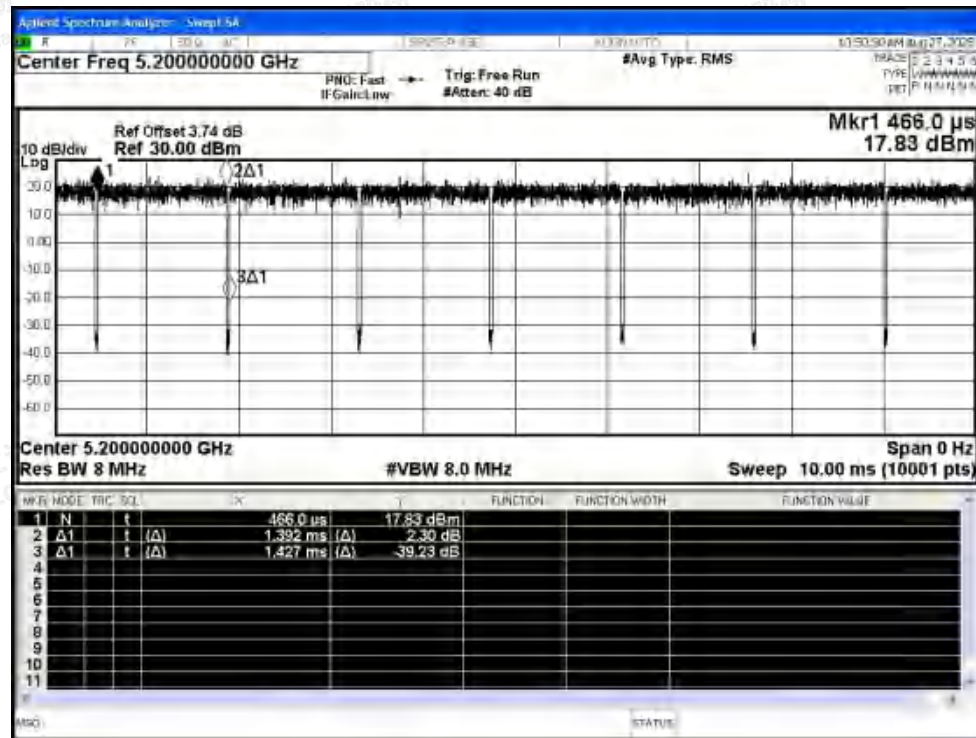

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant1

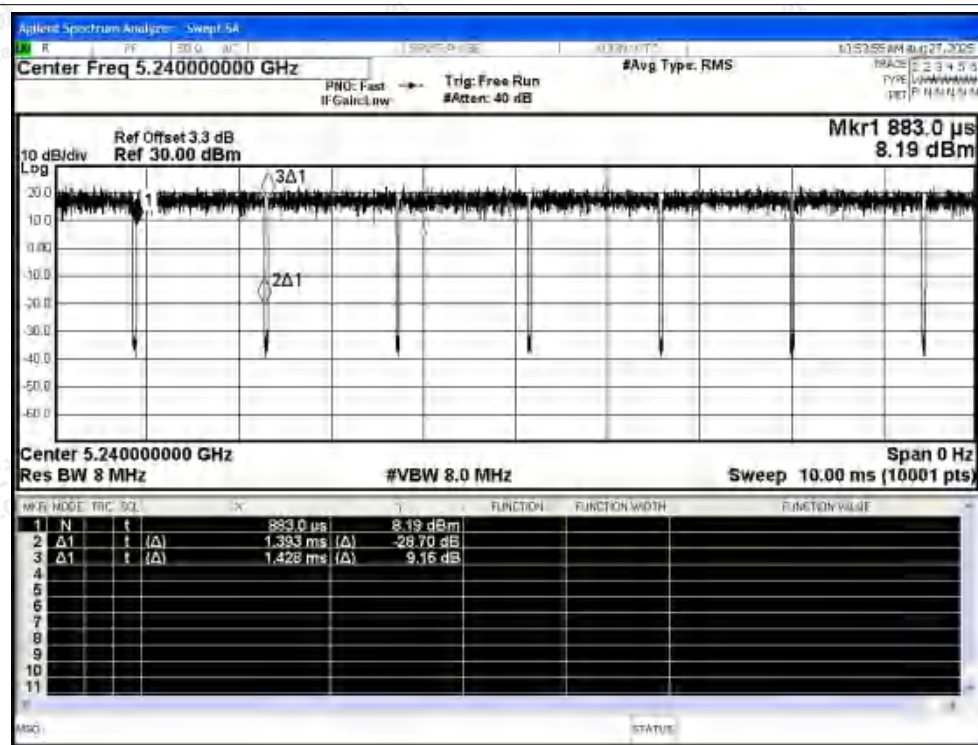

Duty Cycle NVNT n20 5180MHz Ant1

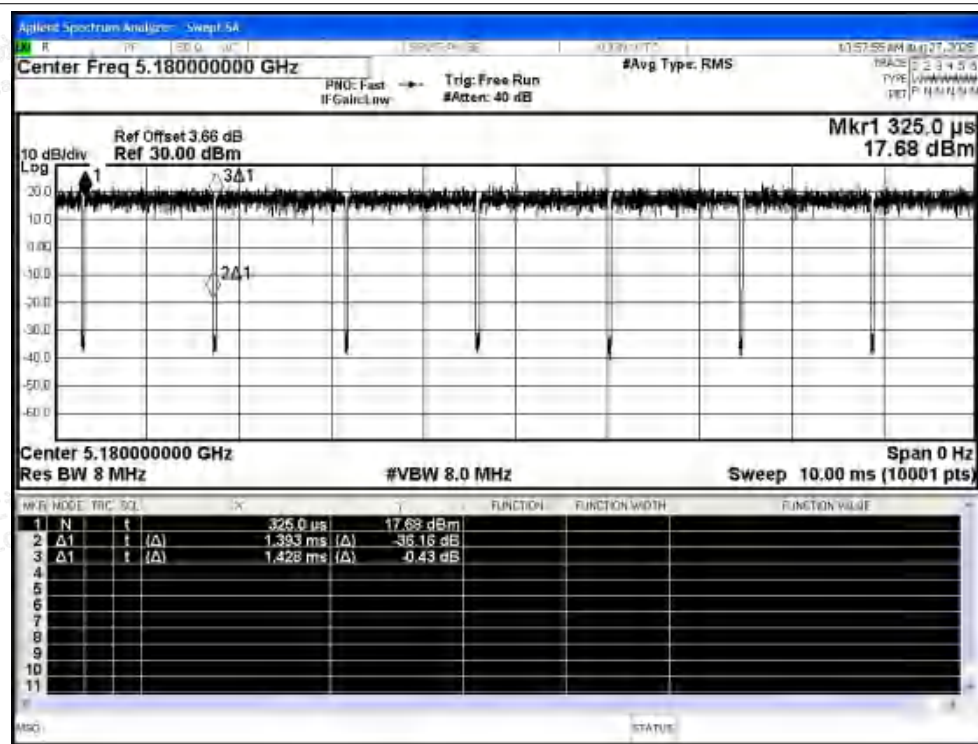

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant1

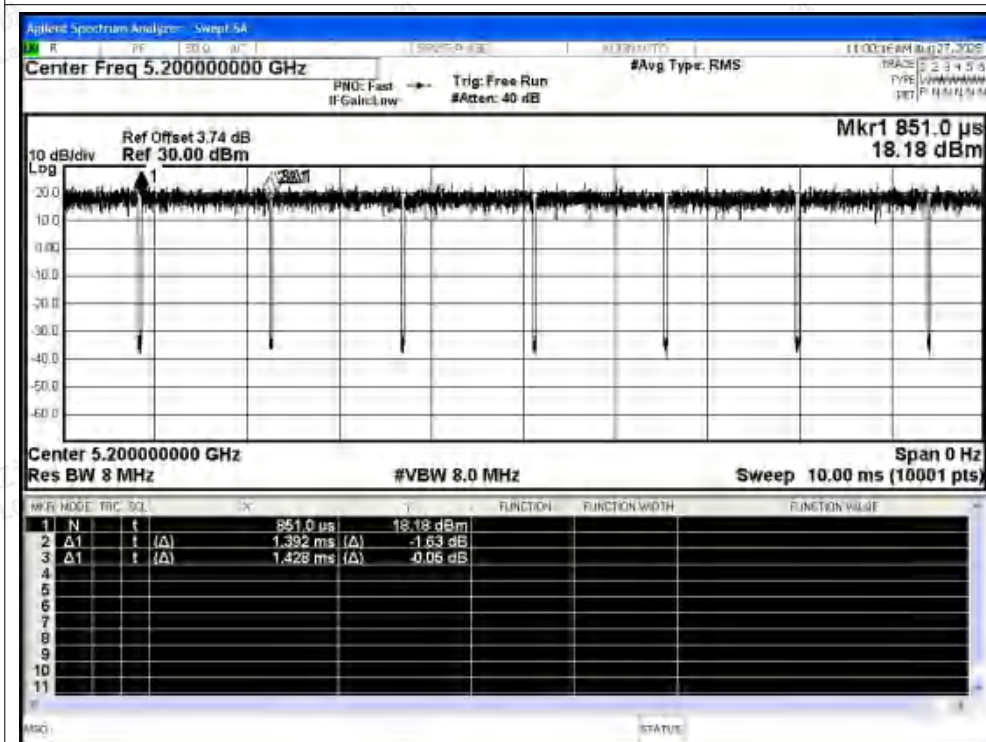

Duty Cycle NVNT n20 5240MHz Ant1

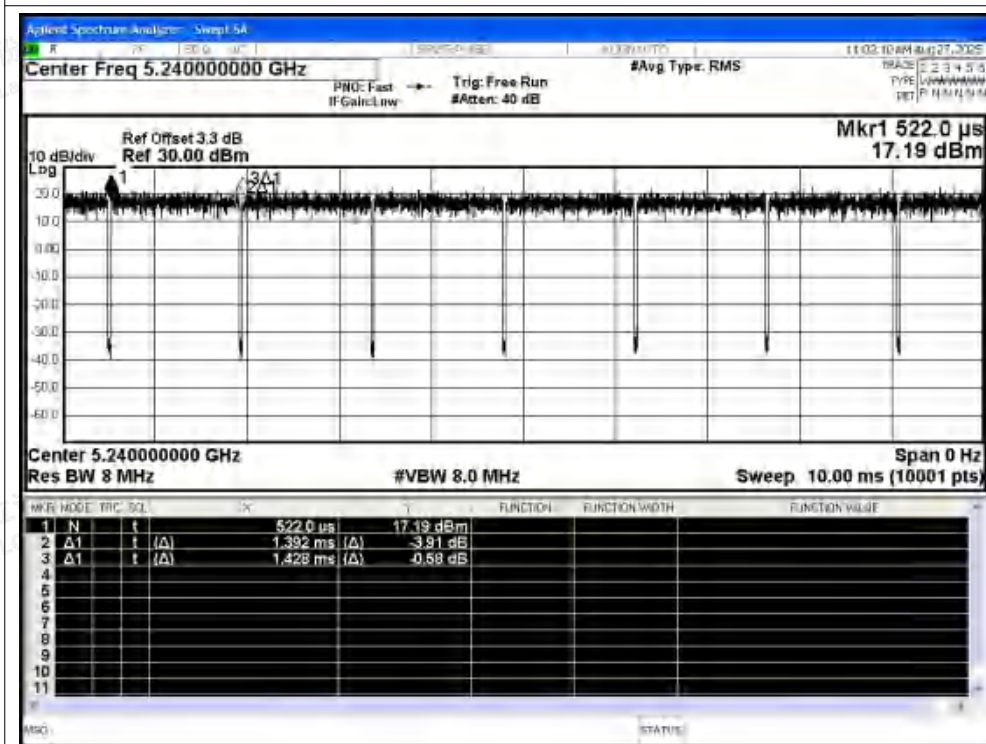

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant1

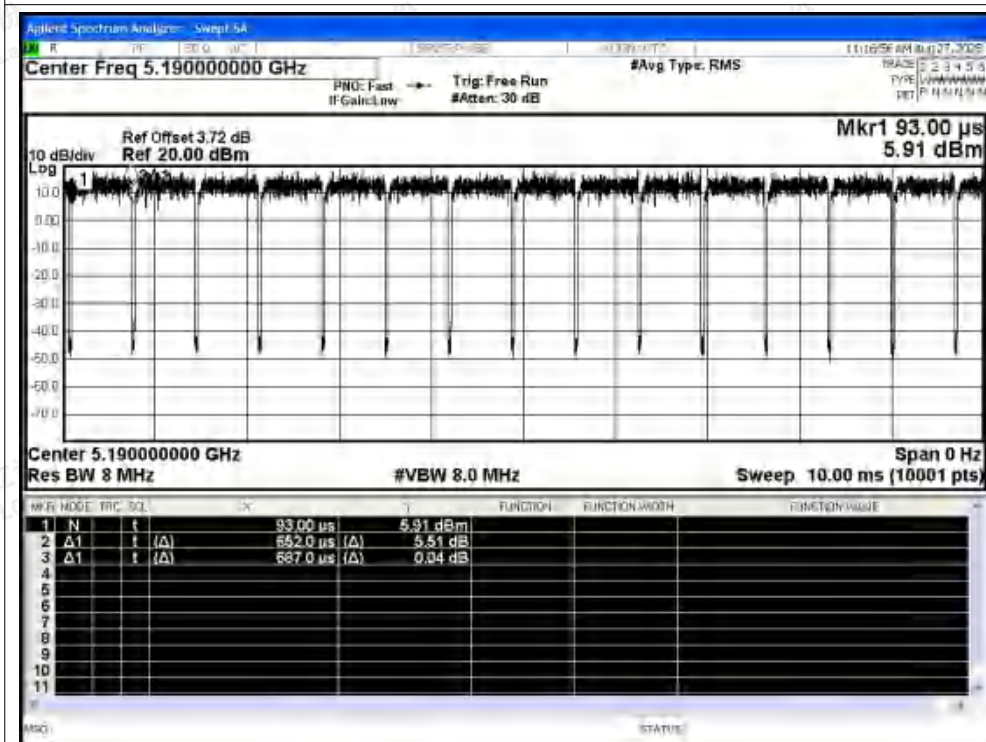


Duty Cycle NVNT n40 5230MHz Ant1

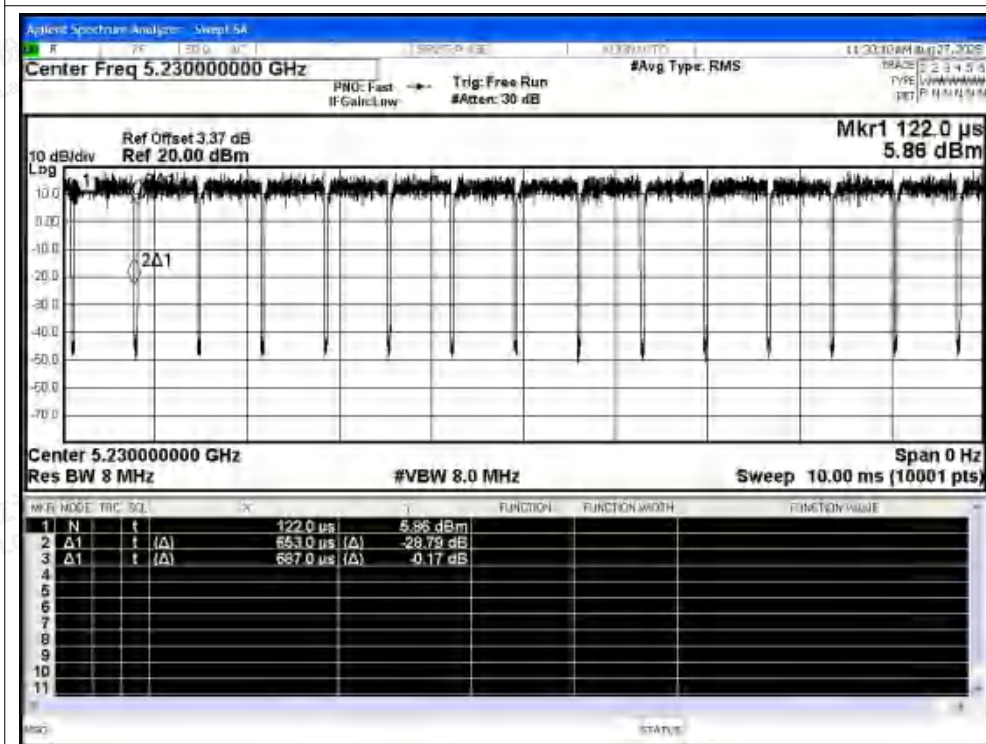




Duty Cycle NVNT ac20 5180MHz Ant1

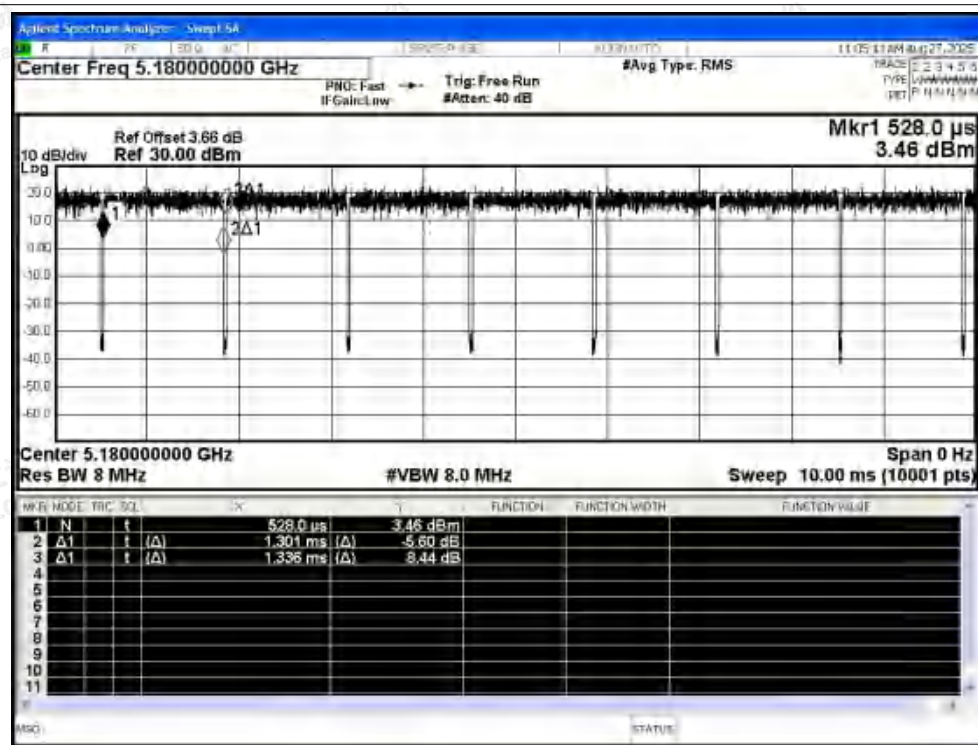

Duty Cycle NVNT ac20 5200MHz Ant1

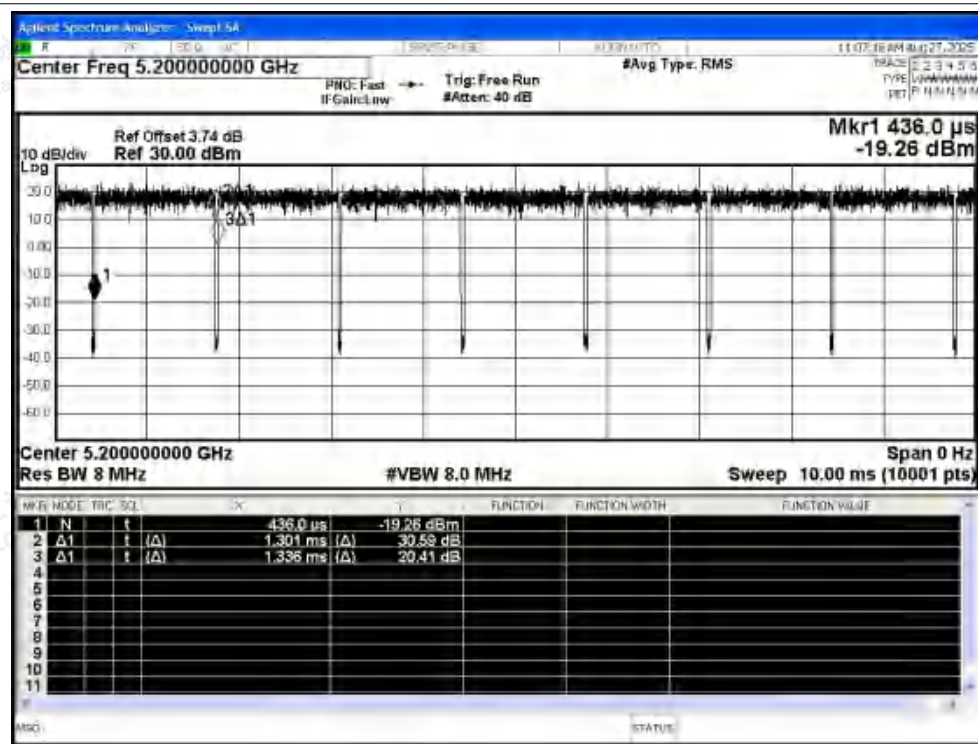

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant1

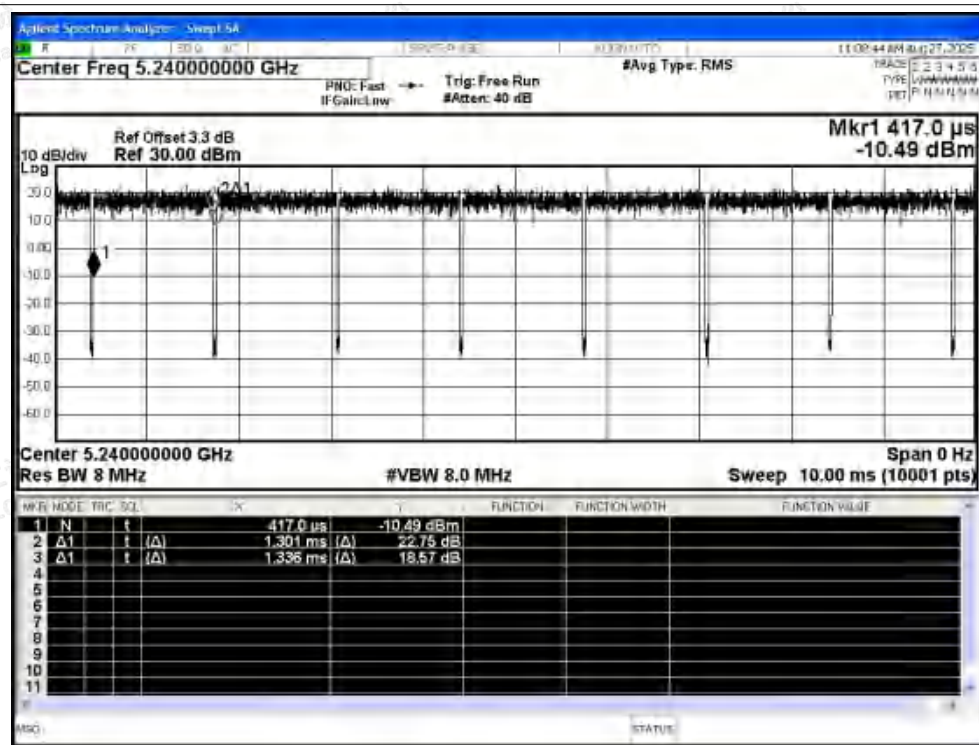

Duty Cycle NVNT ac40 5190MHz Ant1

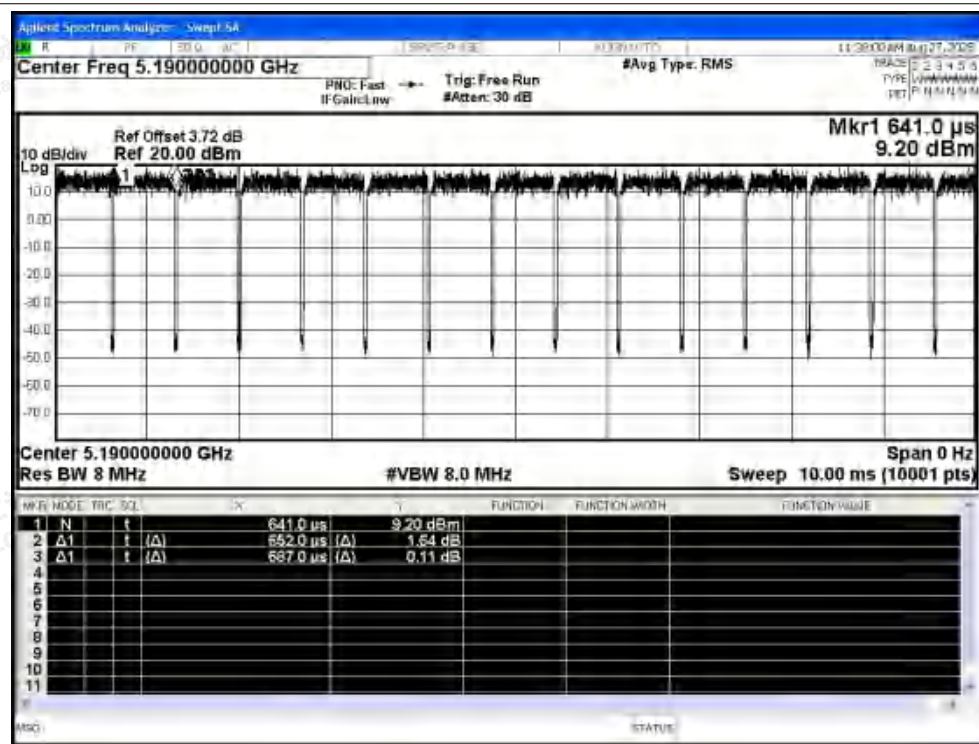

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant1

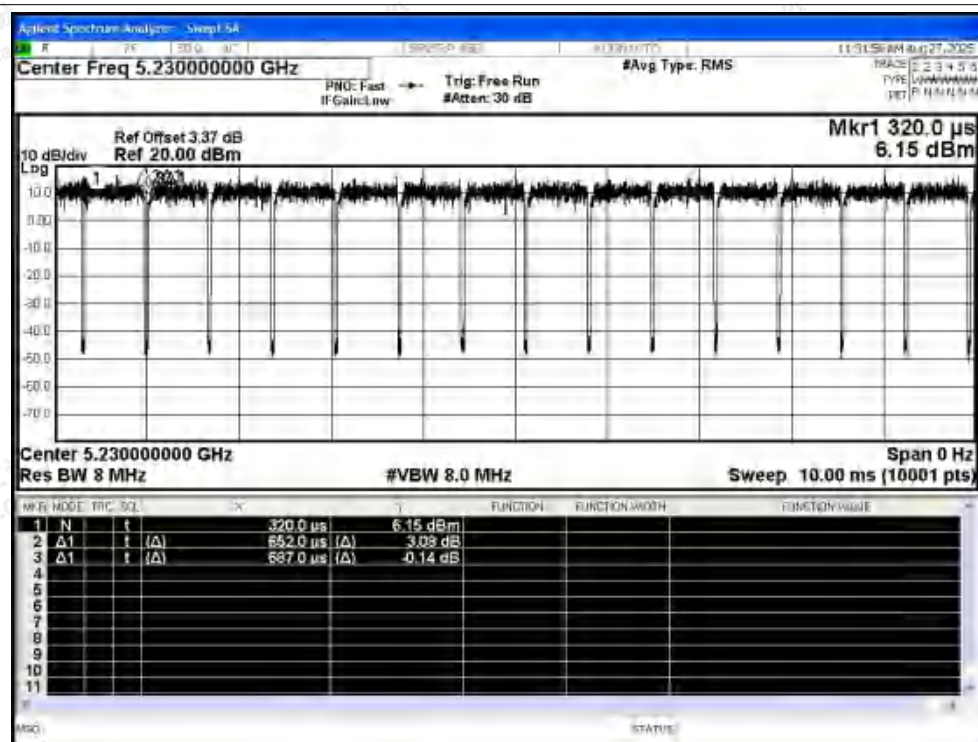

Duty Cycle NVNT ac80 5210MHz Ant1

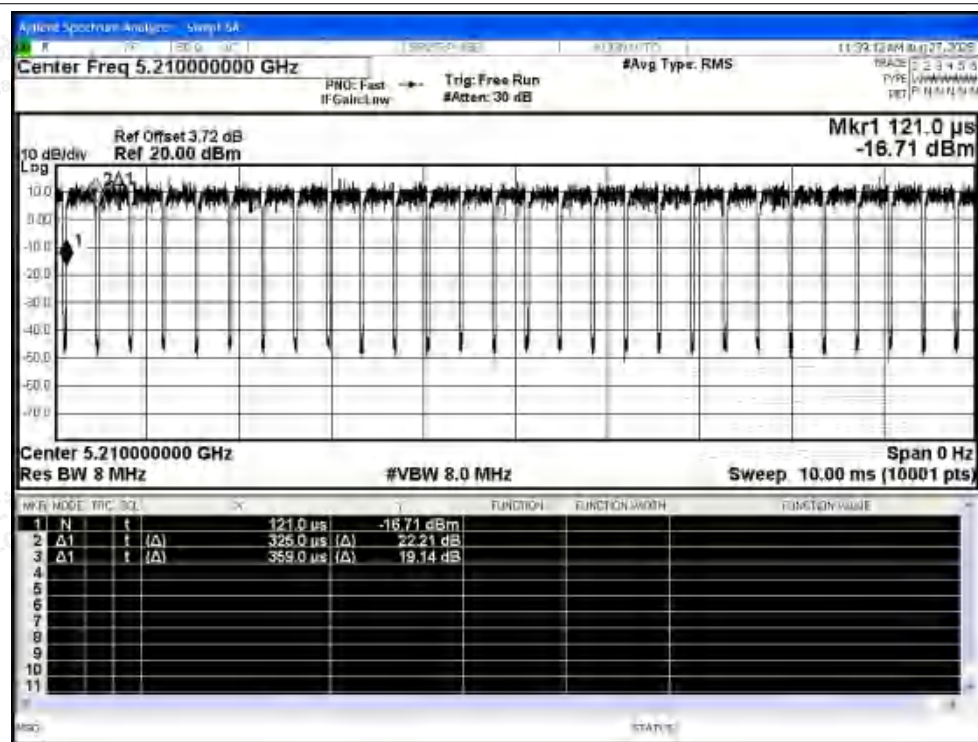

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5180MHz Ant1

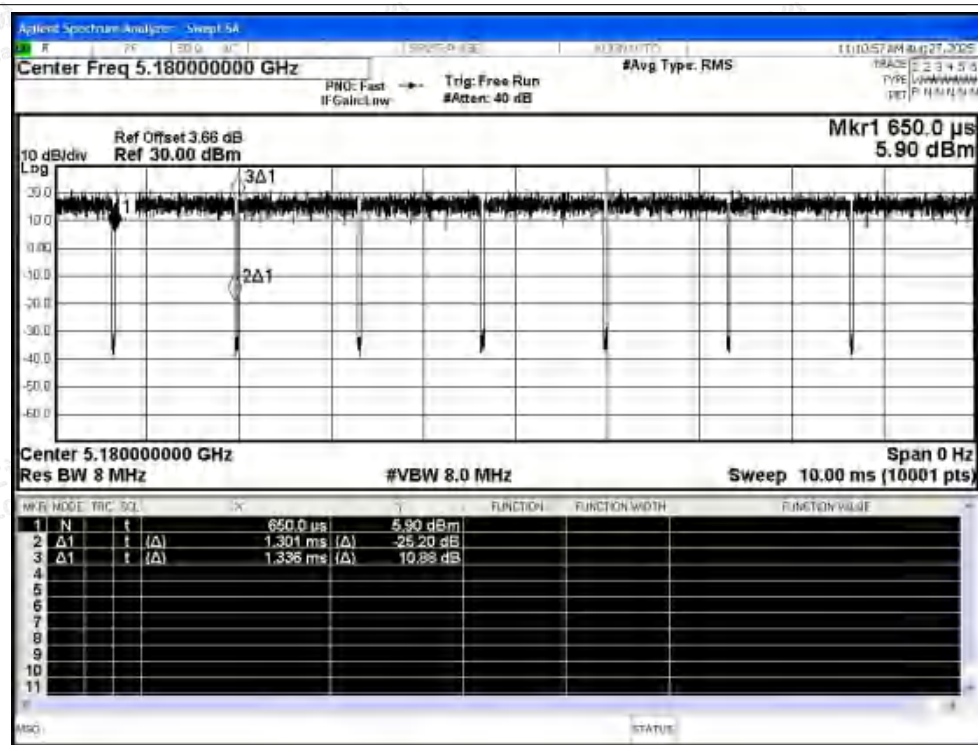

Duty Cycle NVNT ax20 5200MHz Ant1

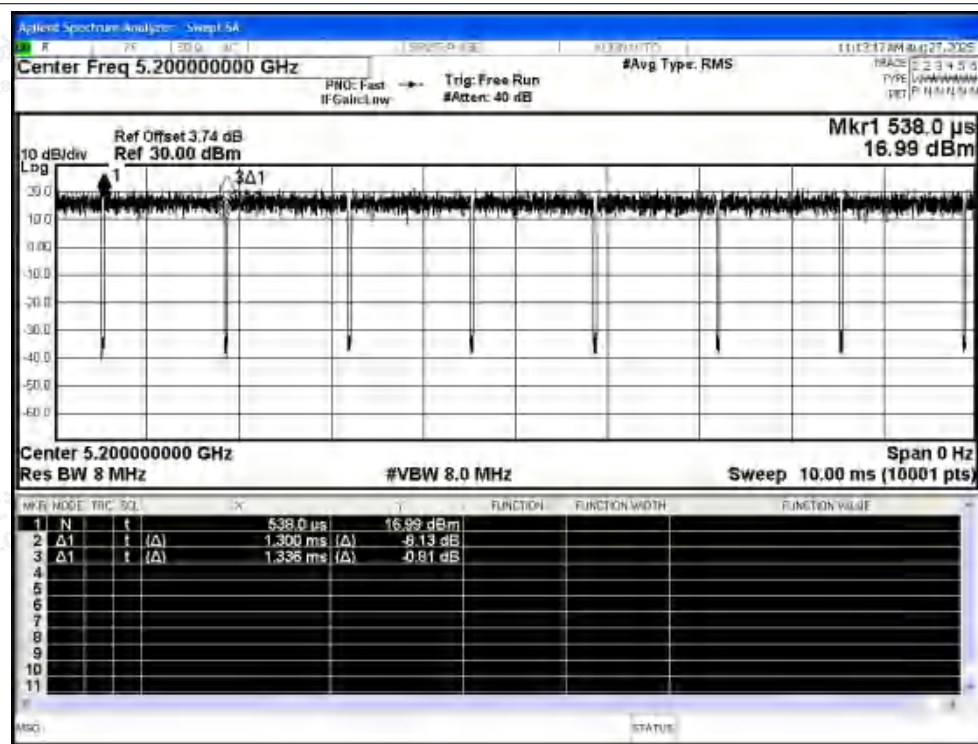

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5240MHz Ant1

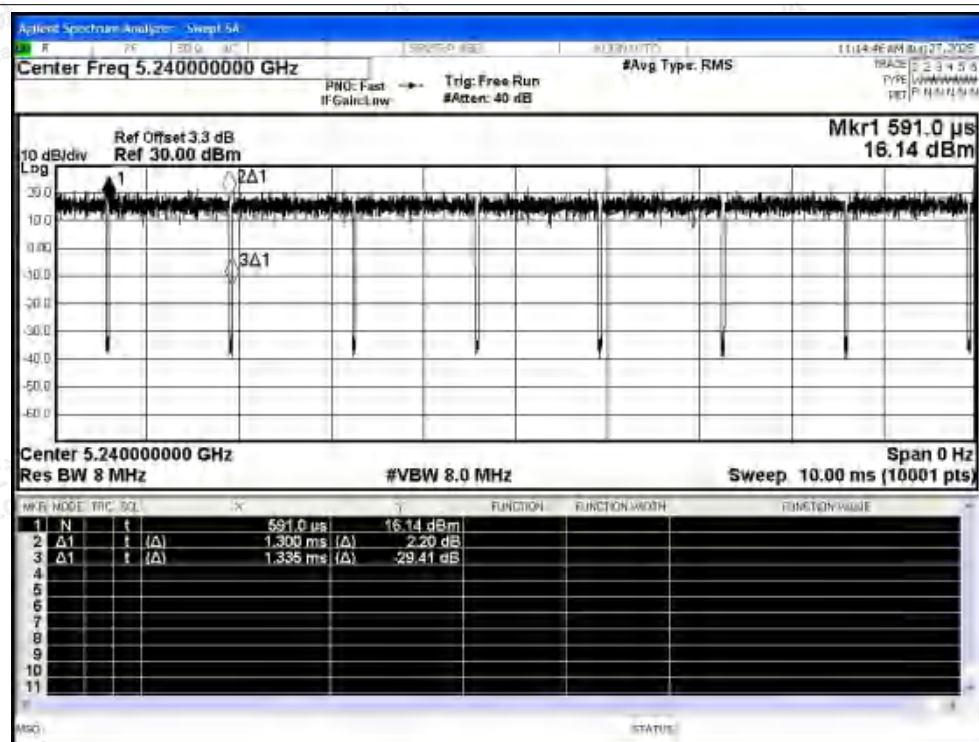

Duty Cycle NVNT ax40 5190MHz Ant1

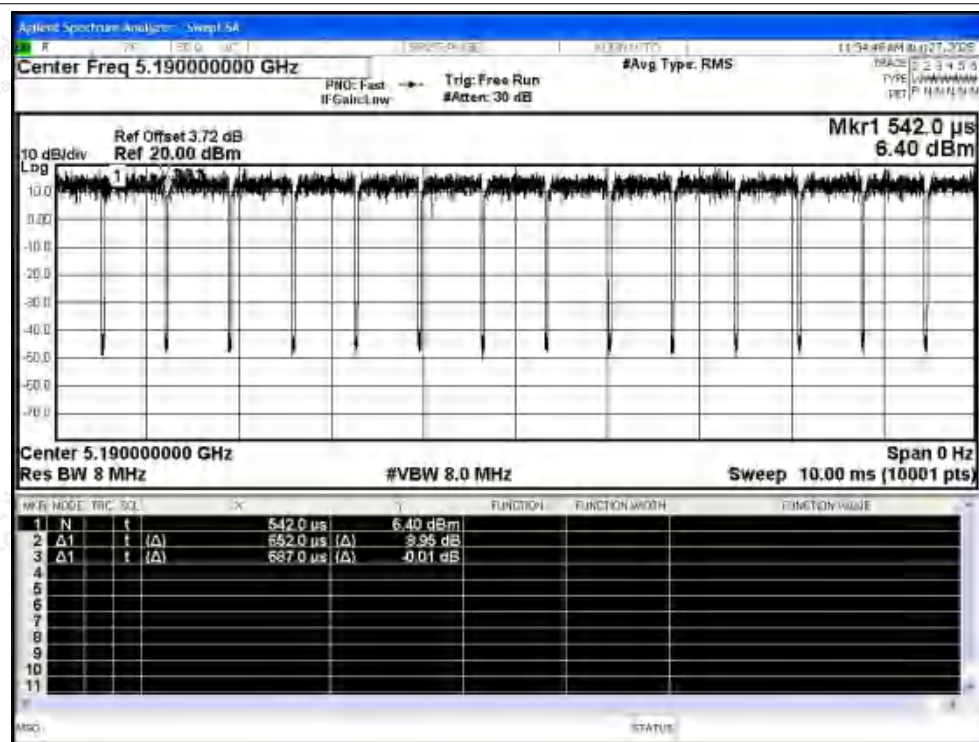

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5230MHz Ant1

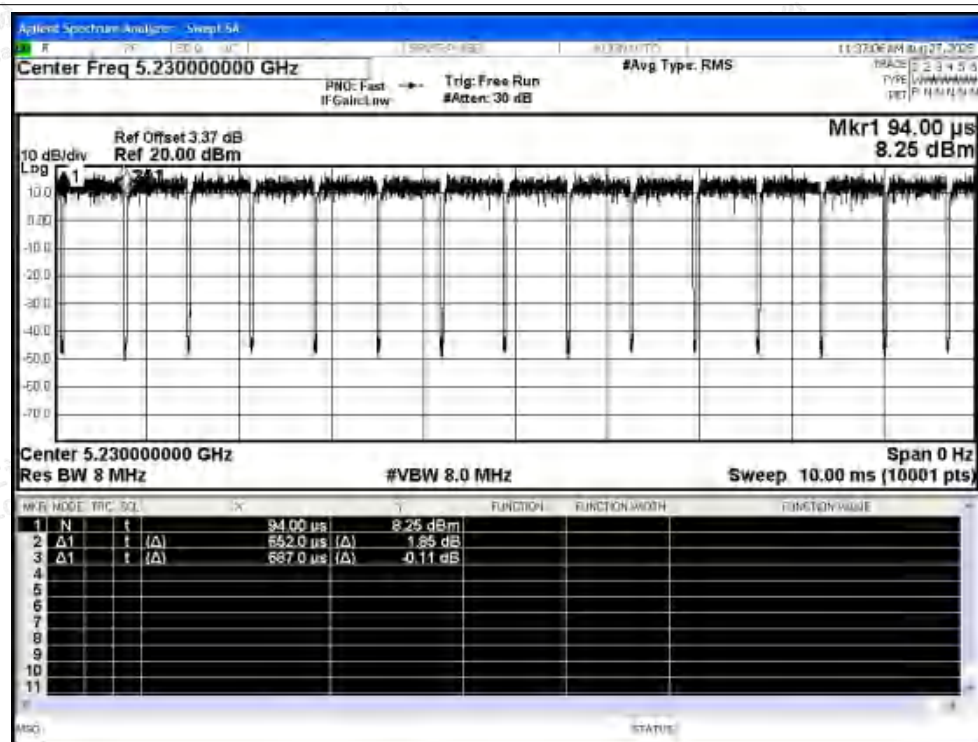


Duty Cycle NVNT ax80 5210MHz Ant1

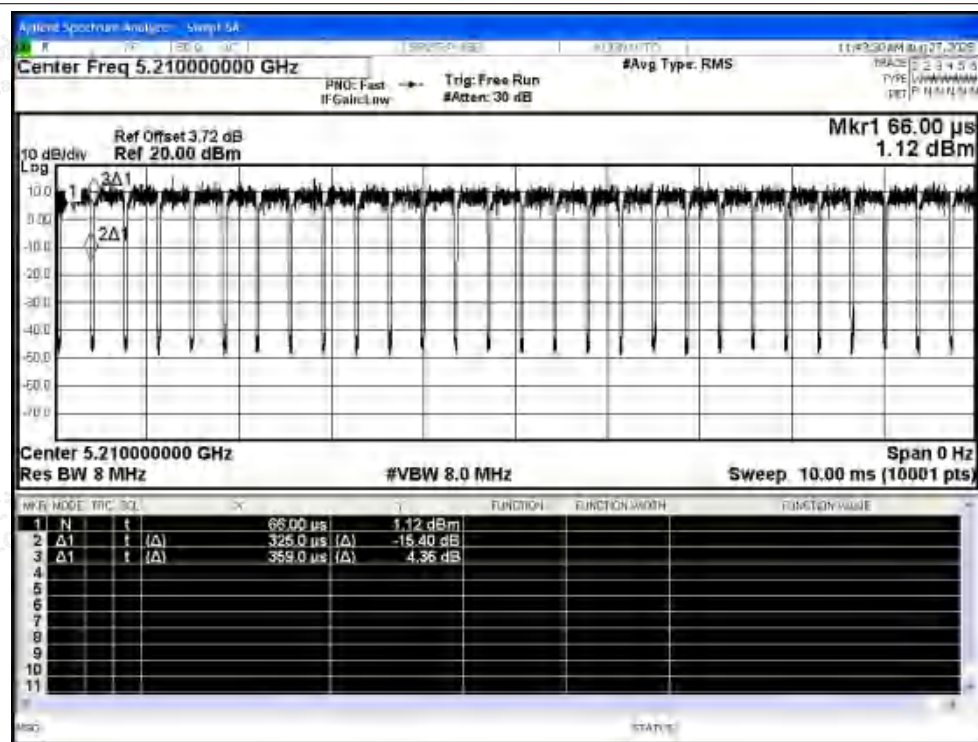





Duty Cycle NVNT ac160 5250MHz Ant1

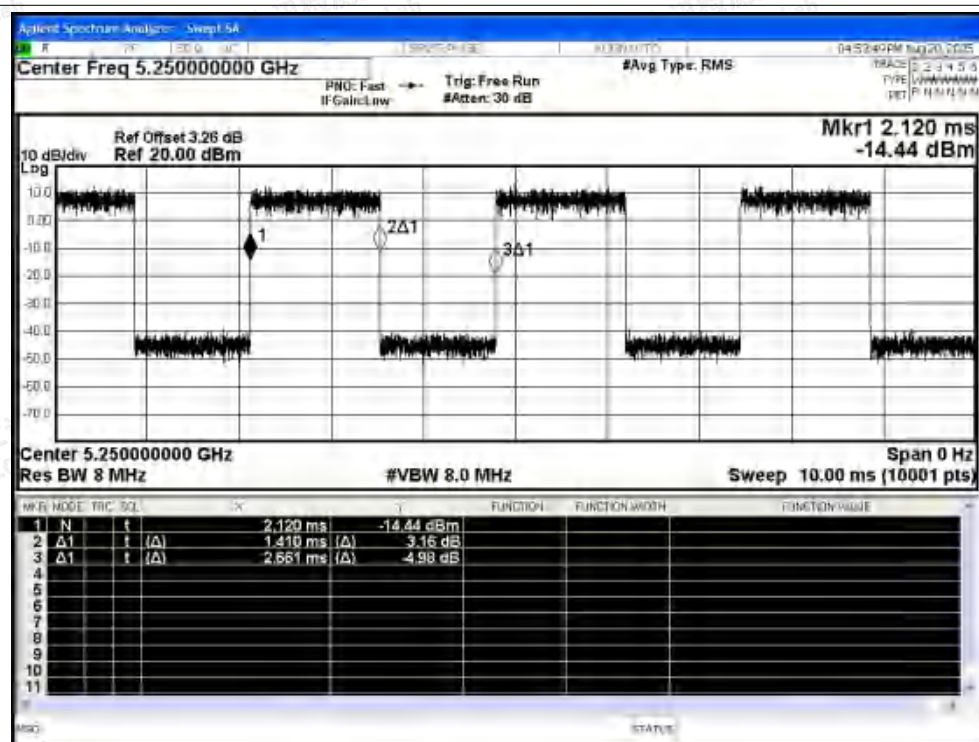

Duty Cycle NVNT ax160 5250MHz Ant1

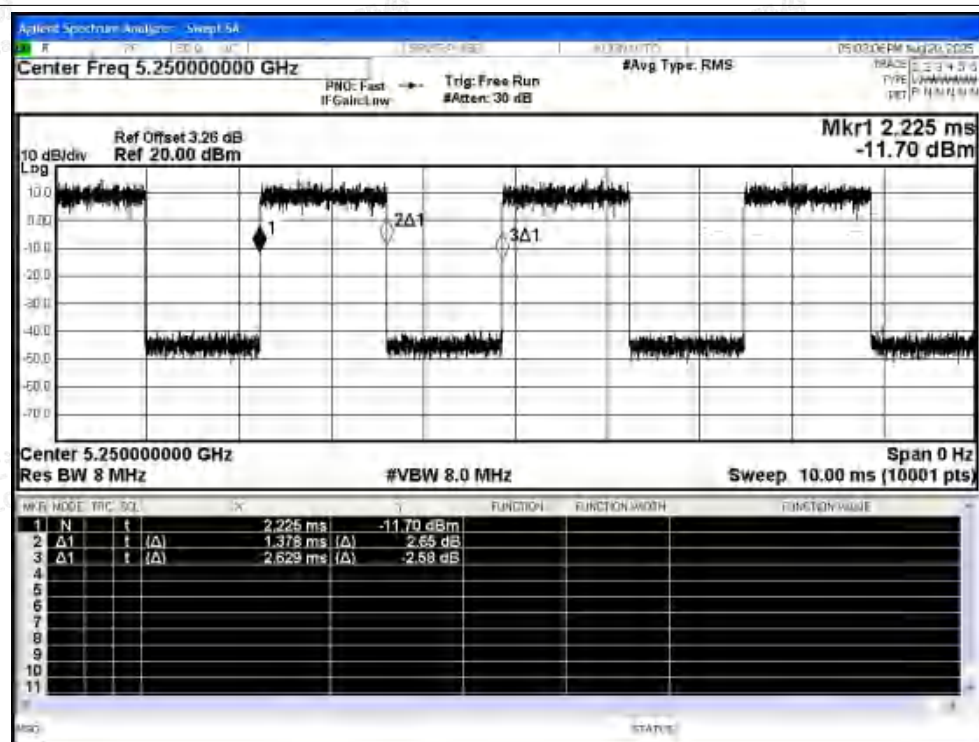



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant2	97.55	0.11	0.72
NVNT	a	5200	Ant2	97.55	0.11	0.72
NVNT	a	5240	Ant2	97.55	0.11	0.72
NVNT	n20	5180	Ant2	97.48	0.11	0.72
NVNT	n20	5200	Ant2	97.55	0.11	0.72
NVNT	n20	5240	Ant2	97.55	0.11	0.72
NVNT	n40	5190	Ant2	95.05	0.22	1.53
NVNT	n40	5230	Ant2	94.91	0.23	1.53
NVNT	ac20	5180	Ant2	97.4	0.11	0.76
NVNT	ac20	5200	Ant2	97.33	0.12	0.76
NVNT	ac20	5240	Ant2	97.4	0.11	0.76
NVNT	ac40	5190	Ant2	95.05	0.22	1.53
NVNT	ac40	5230	Ant2	94.91	0.23	1.53
NVNT	ac80	5210	Ant2	90.5	0.43	3.09
NVNT	ax20	5180	Ant2	97.4	0.11	0.76
NVNT	ax20	5200	Ant2	97.4	0.11	0.76
NVNT	ax20	5240	Ant2	97.33	0.12	0.76
NVNT	ax40	5190	Ant2	95.05	0.22	1.53
NVNT	ax40	5230	Ant2	95.05	0.22	1.53
NVNT	ax80	5210	Ant2	90.53	0.43	3.08
NVNT	ac160	5250	Ant2	52.42	2.81	0.73
NVNT	ax160	5250	Ant2	52.42	2.81	0.73



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant2

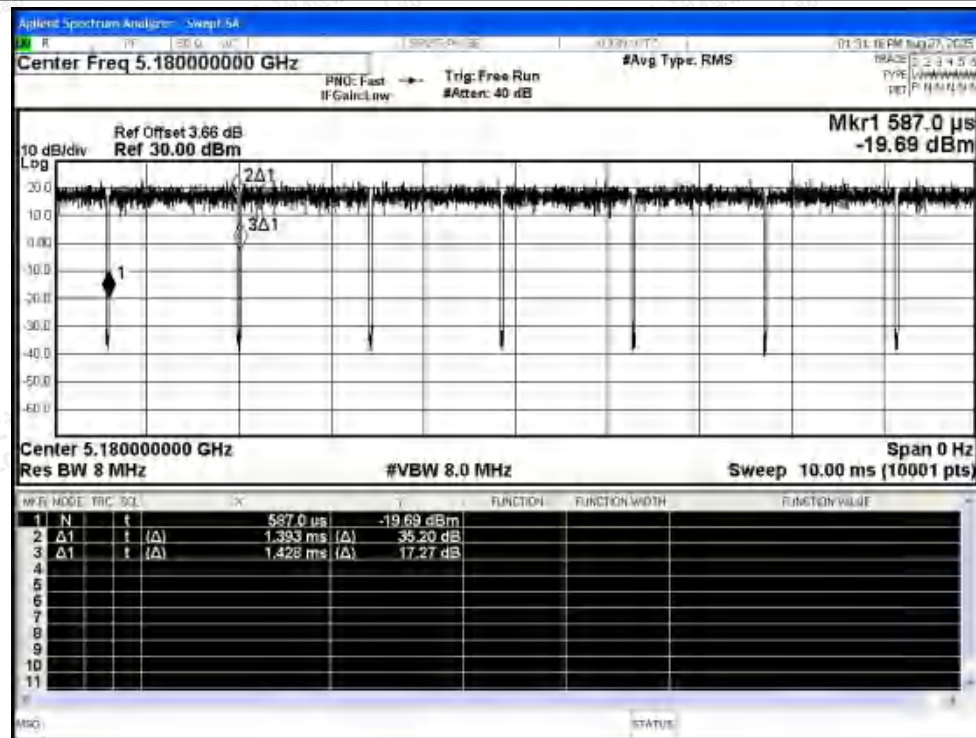

Duty Cycle NVNT a 5200MHz Ant2

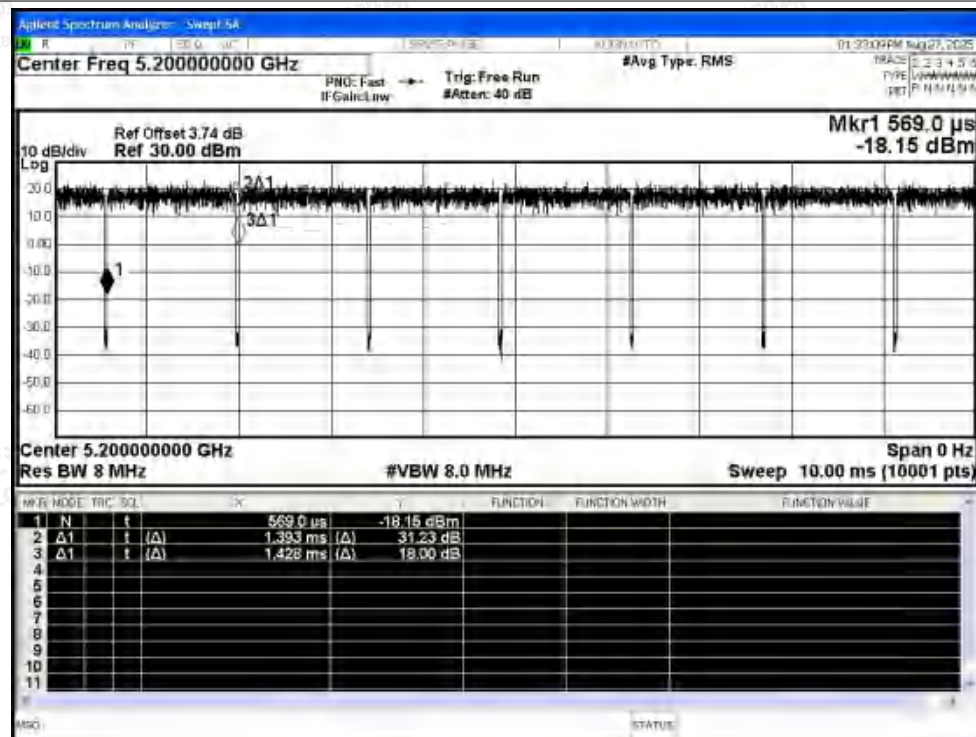

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant2

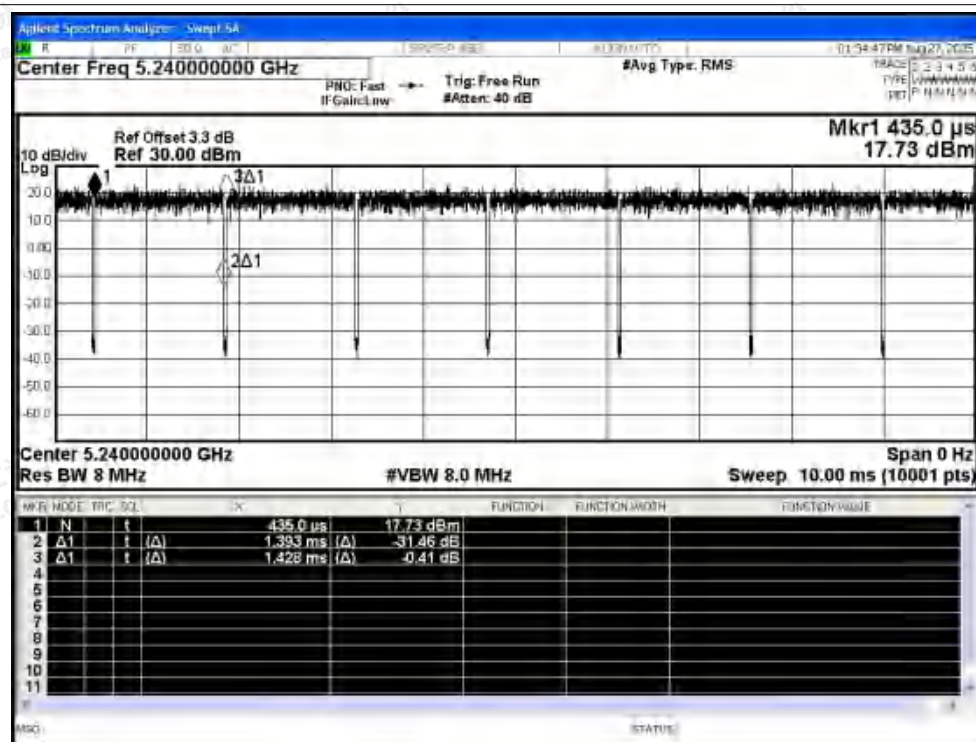

Duty Cycle NVNT n20 5180MHz Ant2

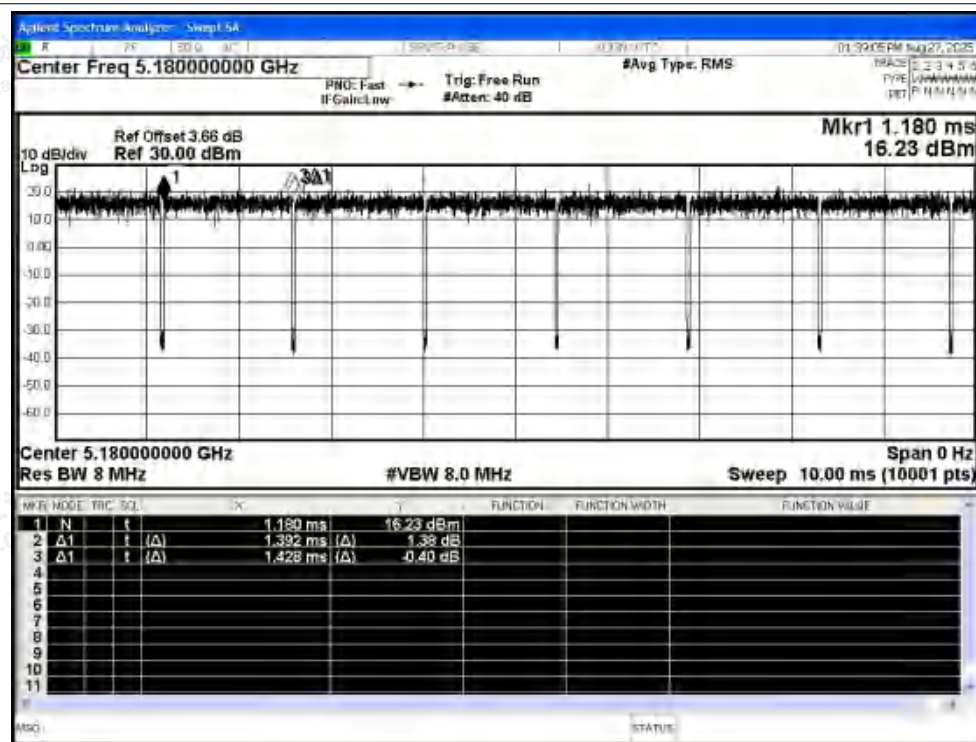

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant2

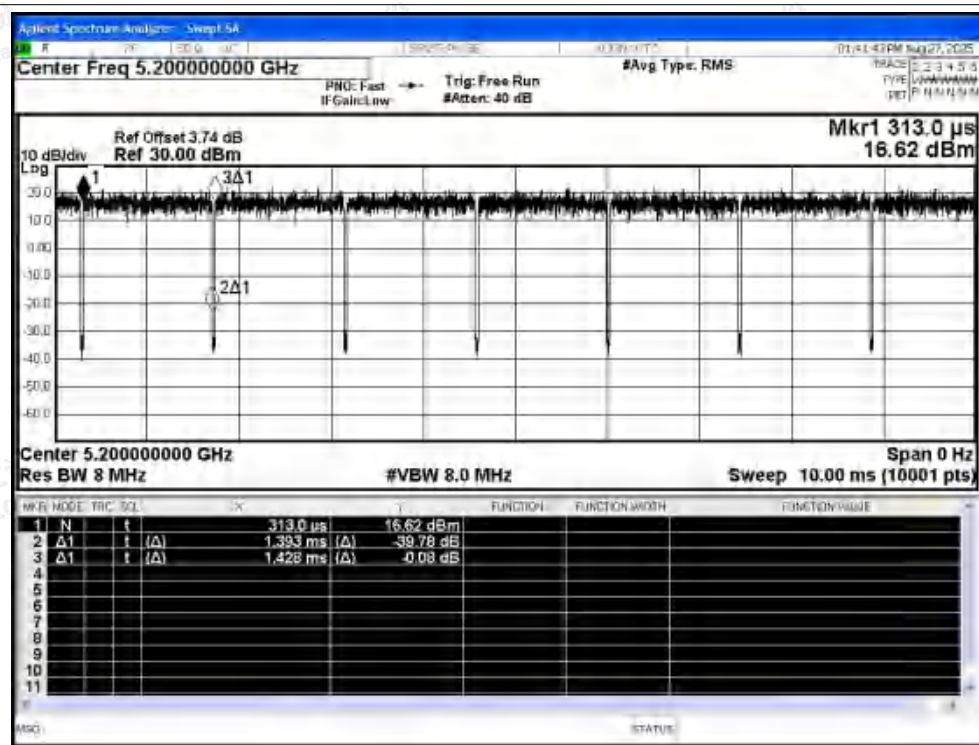

Duty Cycle NVNT n20 5240MHz Ant2

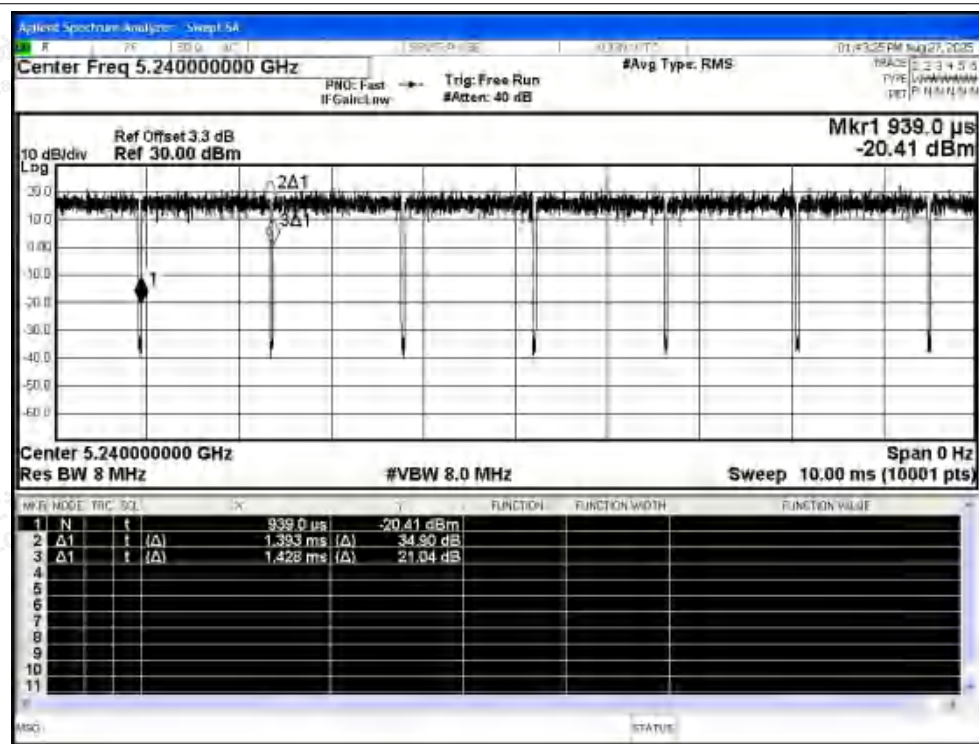

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant2

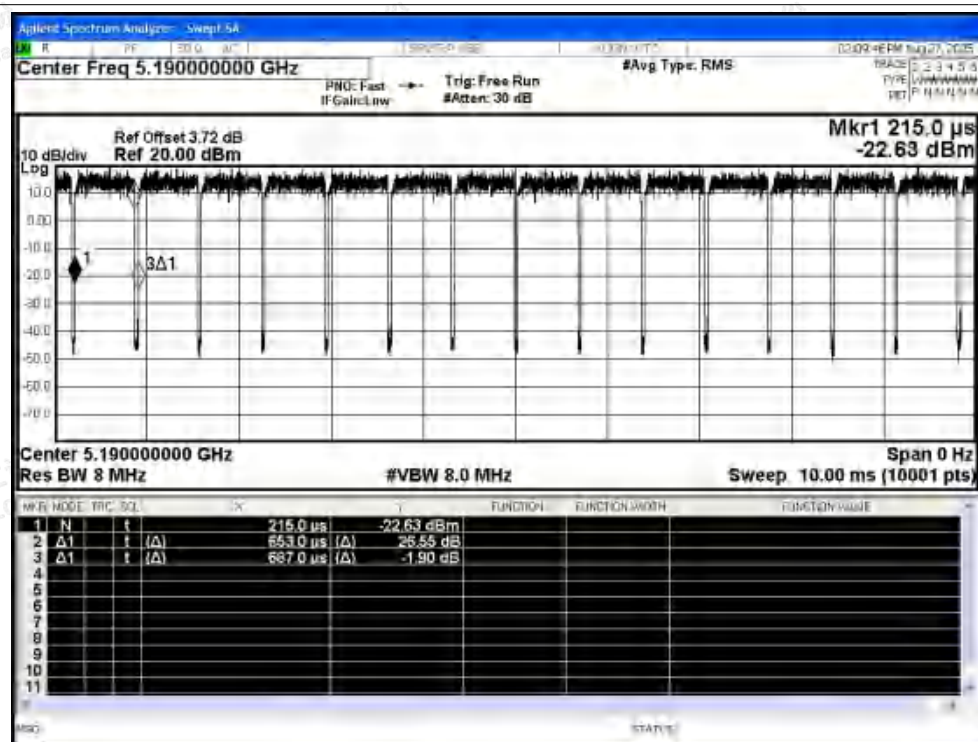

Duty Cycle NVNT n40 5230MHz Ant2

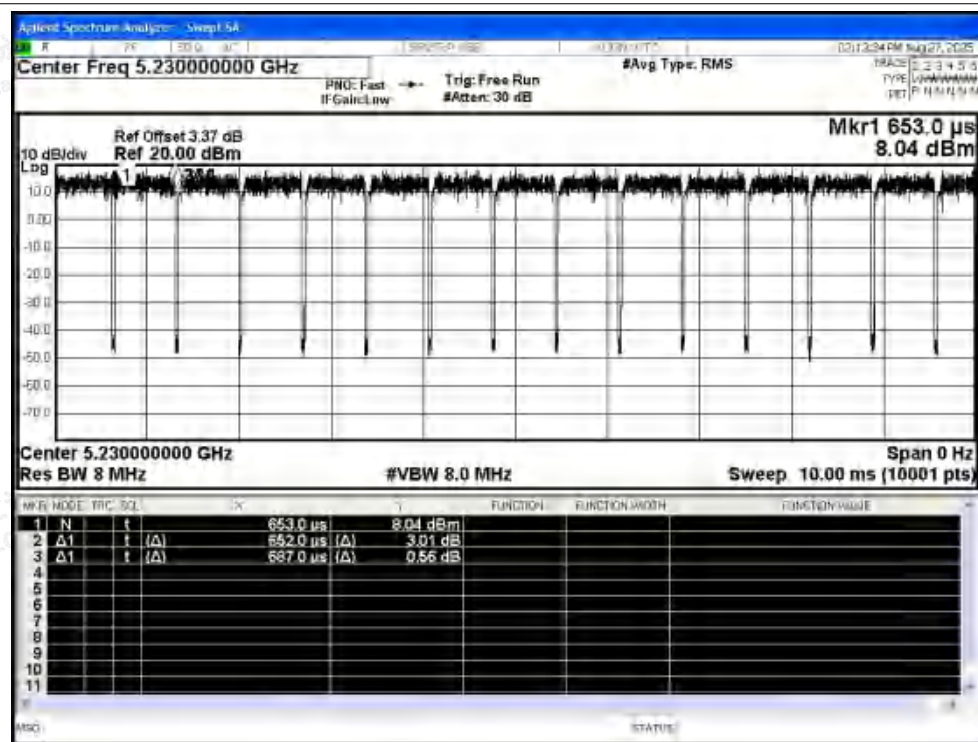

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant2

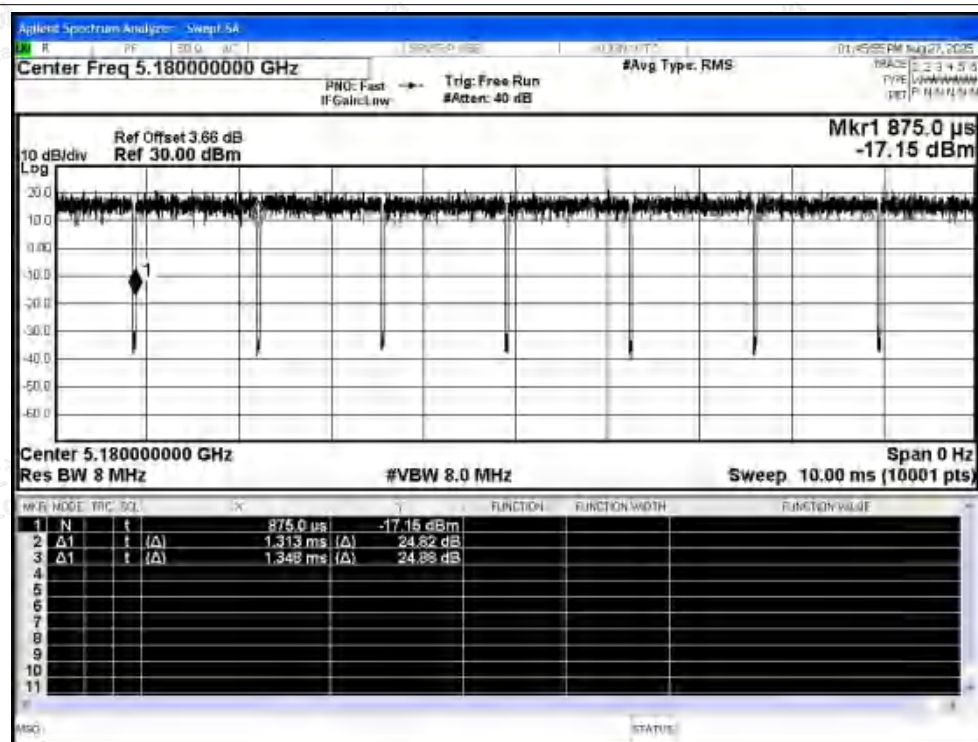

Duty Cycle NVNT ac20 5200MHz Ant2

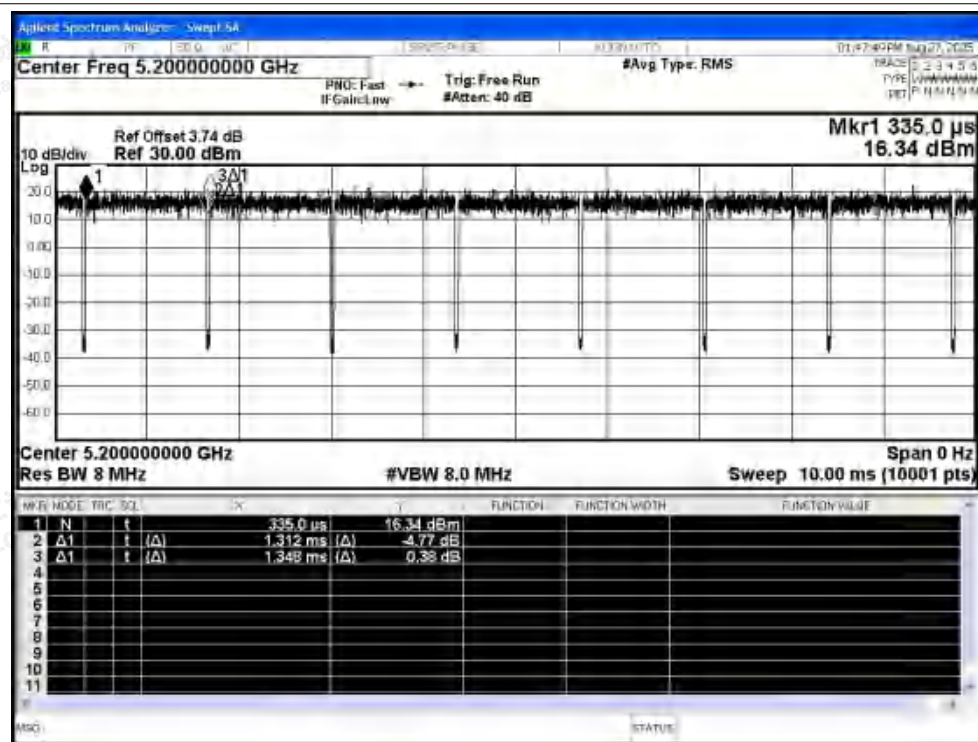


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant2

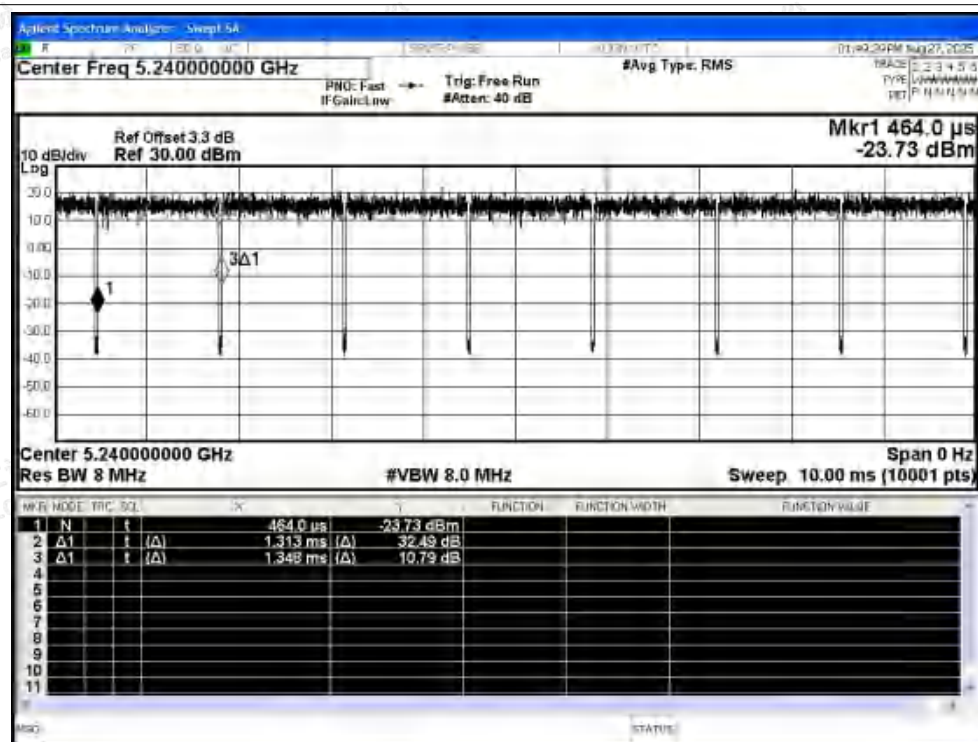


Duty Cycle NVNT ac40 5190MHz Ant2

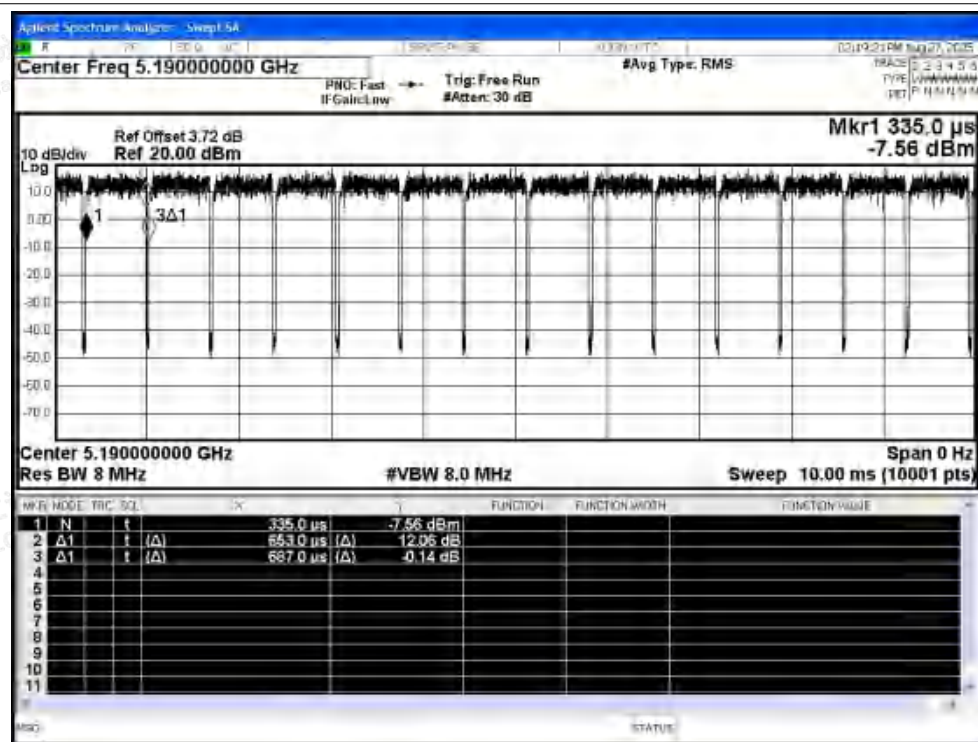




Duty Cycle NVNT ac40 5230MHz Ant2

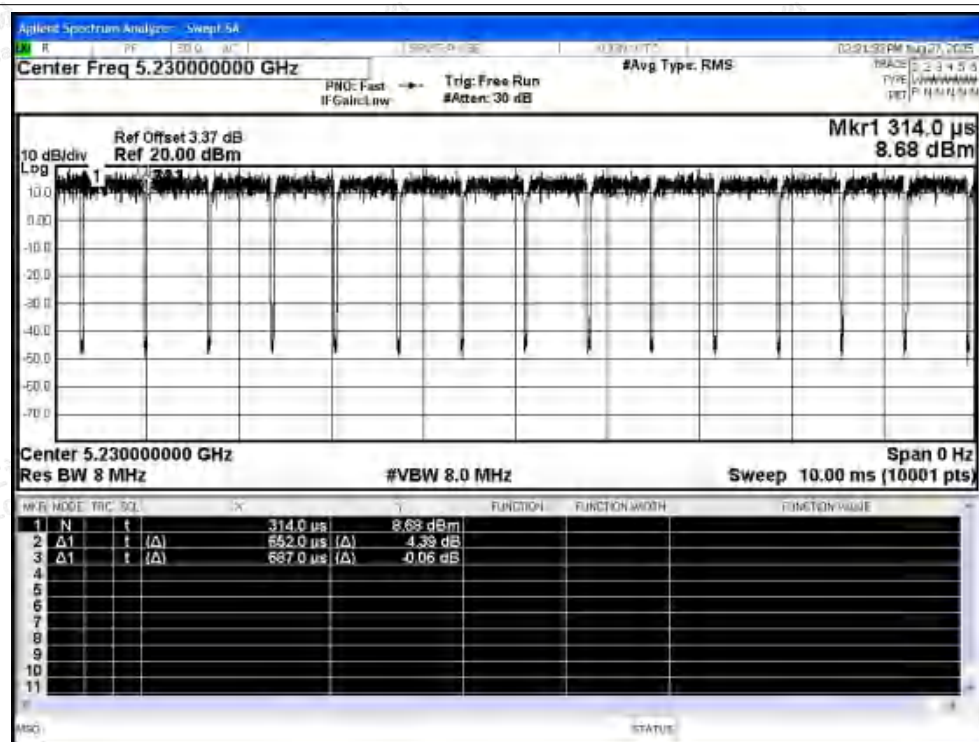

Duty Cycle NVNT ac80 5210MHz Ant2

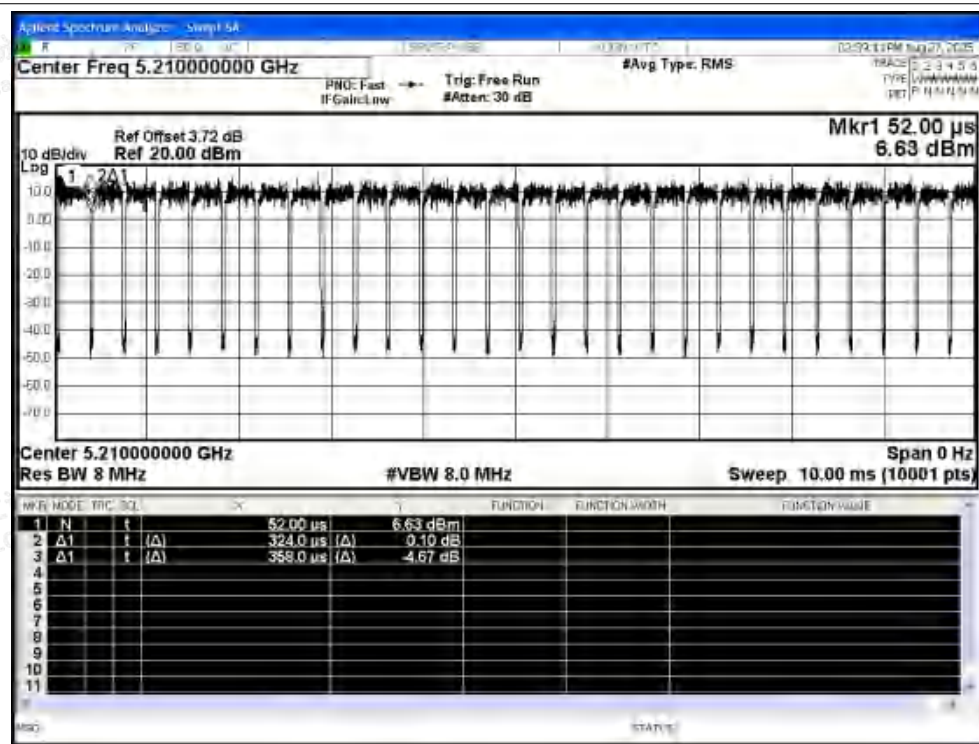

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5180MHz Ant2

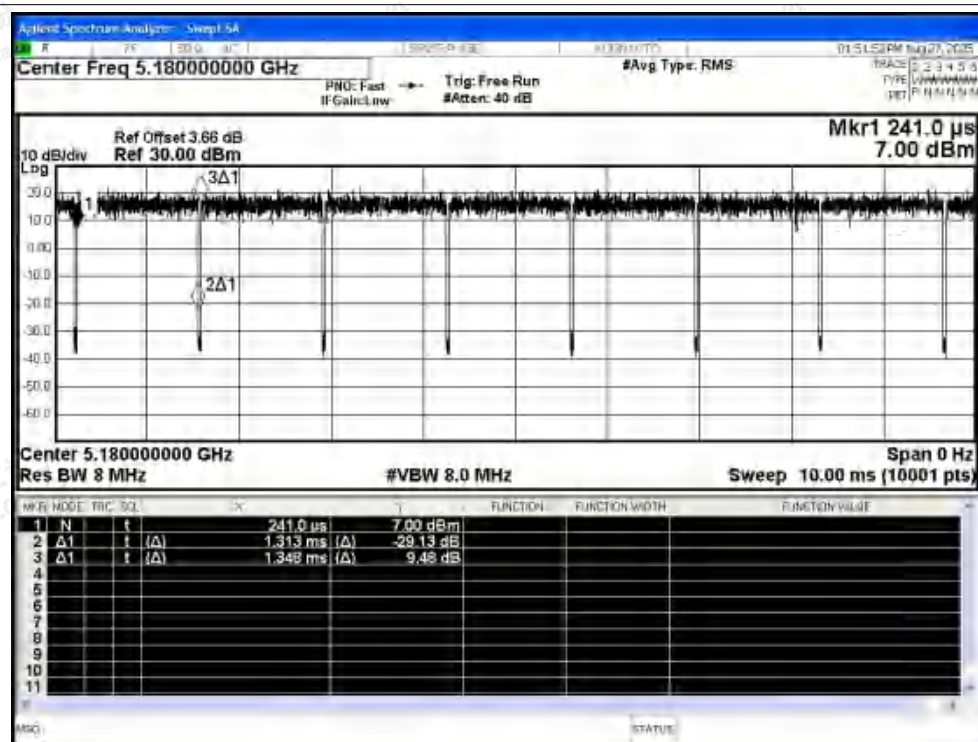

Duty Cycle NVNT ax20 5200MHz Ant2

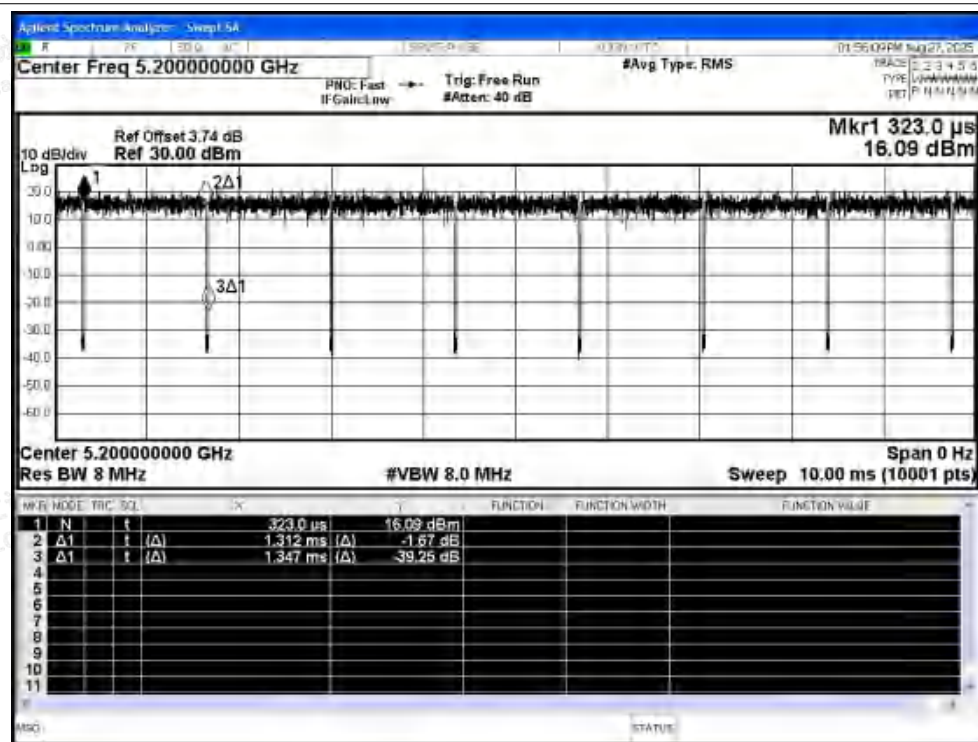


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5240MHz Ant2

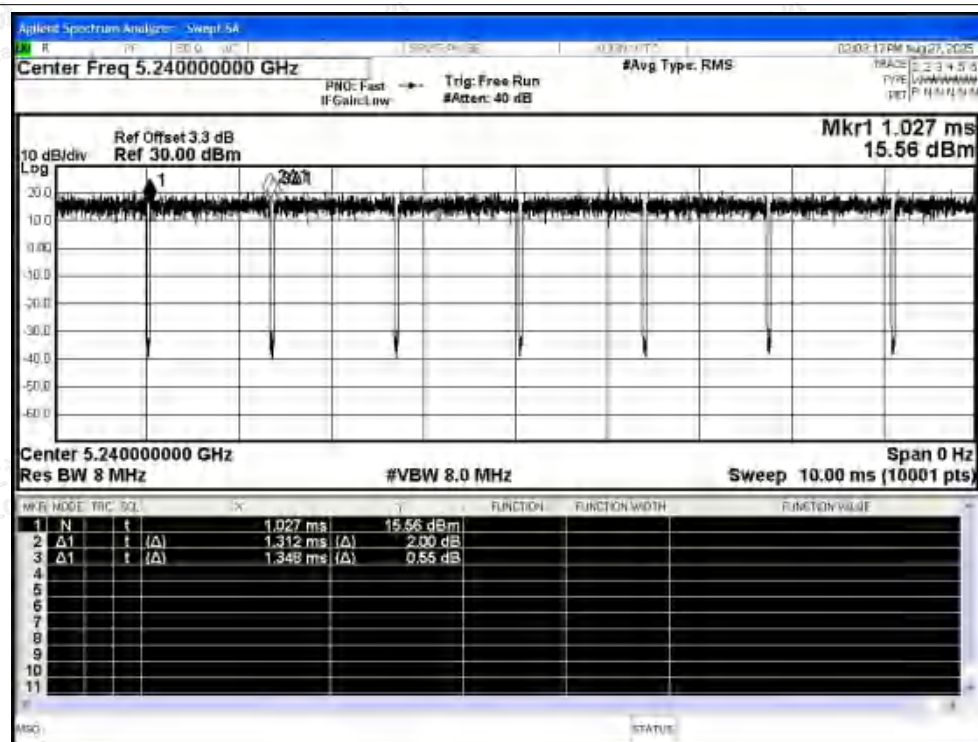

Duty Cycle NVNT ax40 5190MHz Ant2

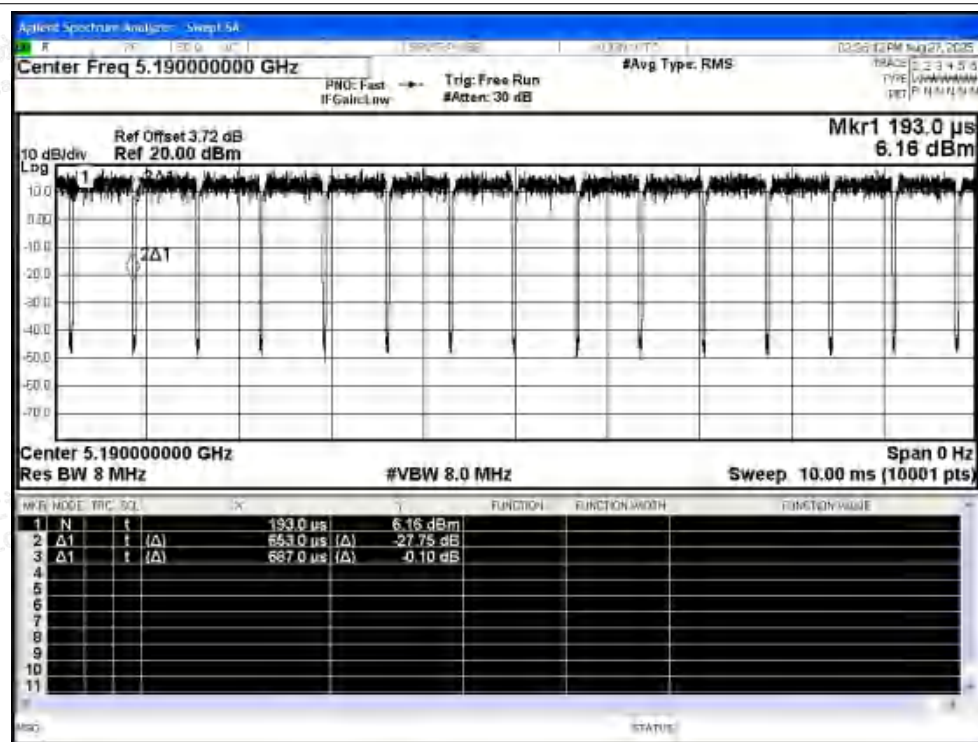


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5230MHz Ant2

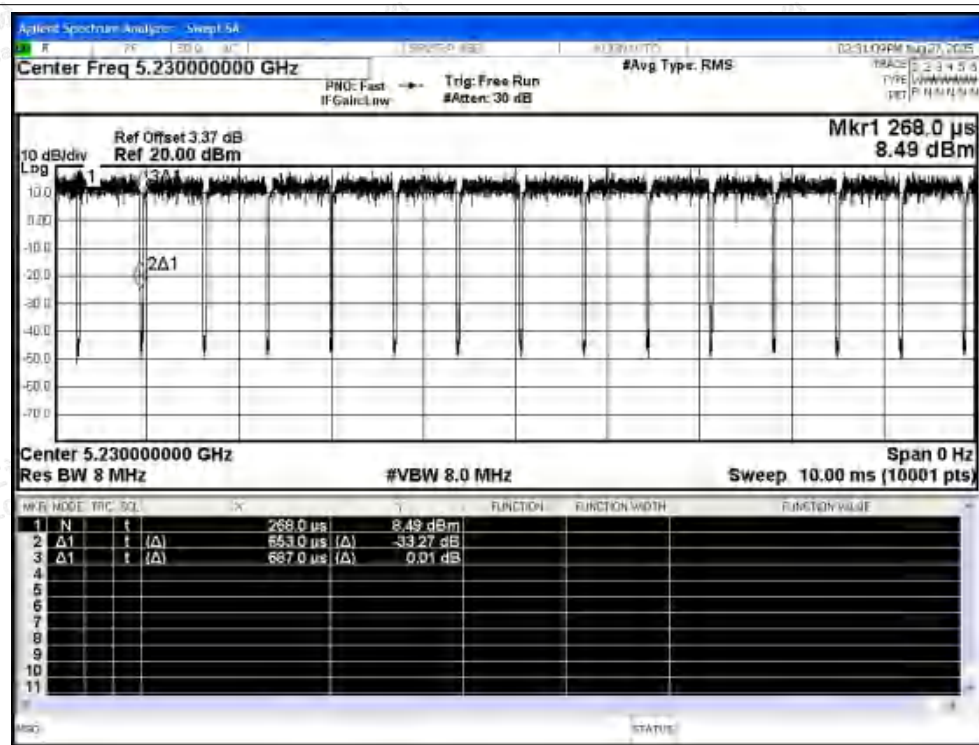

Duty Cycle NVNT ax80 5210MHz Ant2

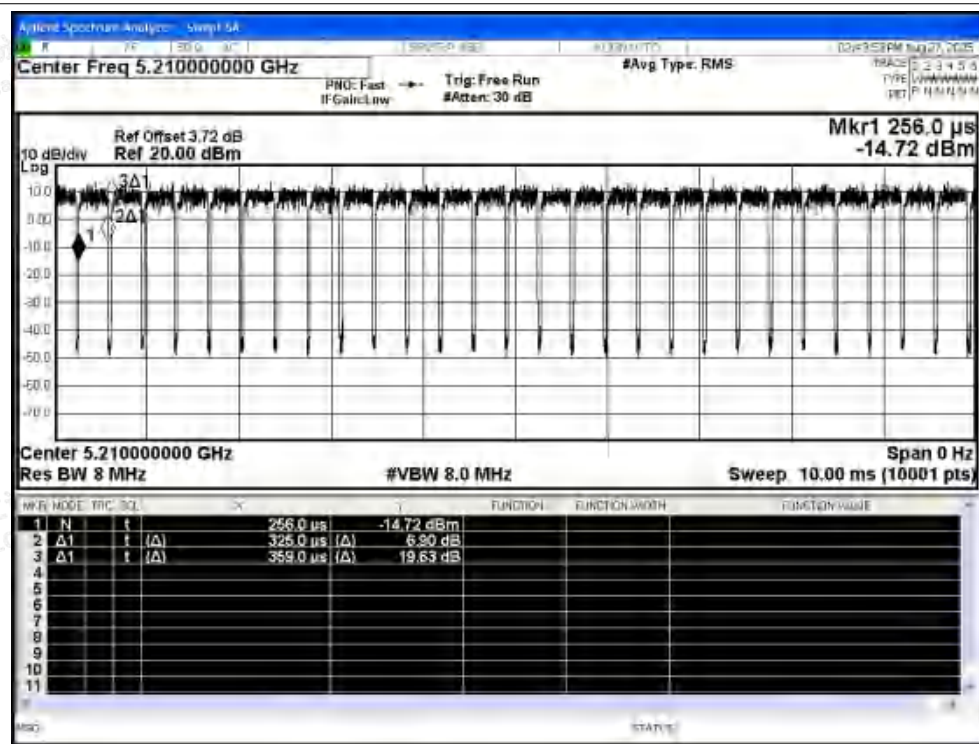

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac160 5250MHz Ant2

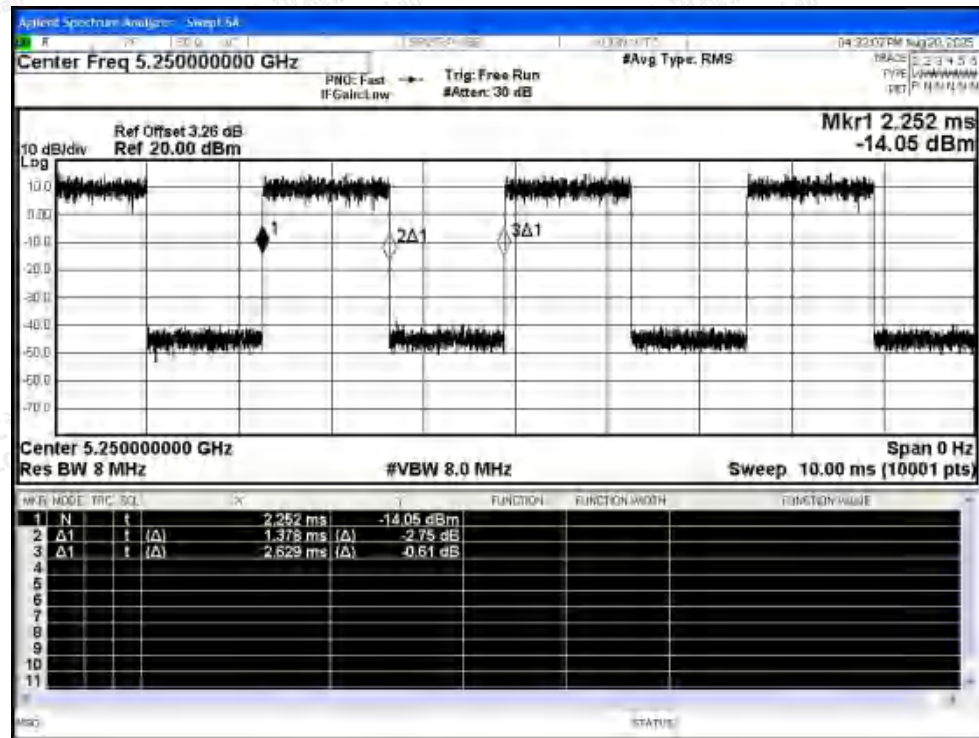

Duty Cycle NVNT ax160 5250MHz Ant2

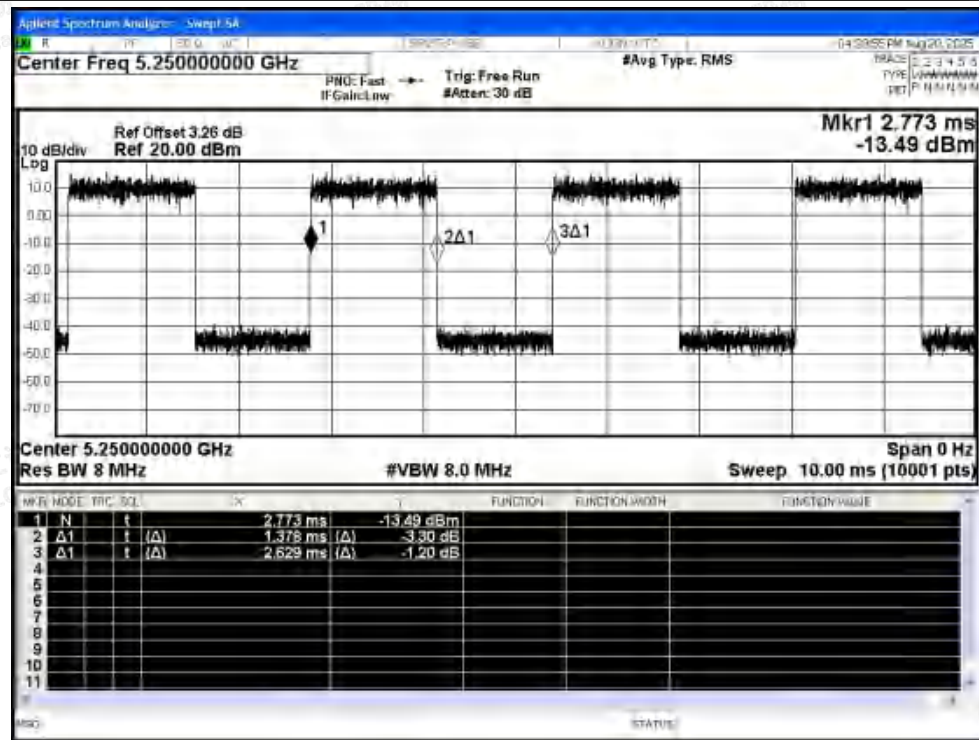

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity