

Appendix D

RF Test Data for 5.8GWIFI (Conducted Measurement)

Product Name: AX3000 Indoor/Outdoor Wi-Fi Access Point

Test Model: OAP3000

Environmental Conditions

Temperature:	24.4°C
Relative Humidity:	53.9%
ATM Pressure:	100.0 kPa
Test Engineer:	Jay Luo
Supervised by:	Paddi Chen




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.1 -6dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-6 dB Bandwidth (MHz)	Limit -6 dB Bandwidth (MHz)	Verdict
NVNT	a	5745	Ant1	16.416	≥ 0.5	Pass
NVNT	a	5785	Ant1	16.396	≥ 0.5	Pass
NVNT	a	5825	Ant1	16.415	≥ 0.5	Pass
NVNT	n20	5745	Ant1	17.611	≥ 0.5	Pass
NVNT	n20	5785	Ant1	17.573	≥ 0.5	Pass
NVNT	n20	5825	Ant1	17.219	≥ 0.5	Pass
NVNT	n40	5755	Ant1	36.318	≥ 0.5	Pass
NVNT	n40	5795	Ant1	36.136	≥ 0.5	Pass
NVNT	ac20	5745	Ant1	17.609	≥ 0.5	Pass
NVNT	ac20	5785	Ant1	17.497	≥ 0.5	Pass
NVNT	ac20	5825	Ant1	17.552	≥ 0.5	Pass
NVNT	ac40	5755	Ant1	36.076	≥ 0.5	Pass
NVNT	ac40	5795	Ant1	36.144	≥ 0.5	Pass
NVNT	ac80	5775	Ant1	75.969	≥ 0.5	Pass
NVNT	ax20	5745	Ant1	17.59	≥ 0.5	Pass
NVNT	ax20	5785	Ant1	17.576	≥ 0.5	Pass
NVNT	ax20	5825	Ant1	17.493	≥ 0.5	Pass
NVNT	ax40	5755	Ant1	36.301	≥ 0.5	Pass
NVNT	ax40	5795	Ant1	36.577	≥ 0.5	Pass
NVNT	ax80	5775	Ant1	76.092	≥ 0.5	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

-6dB Bandwidth NVNT a 5745MHz Ant1

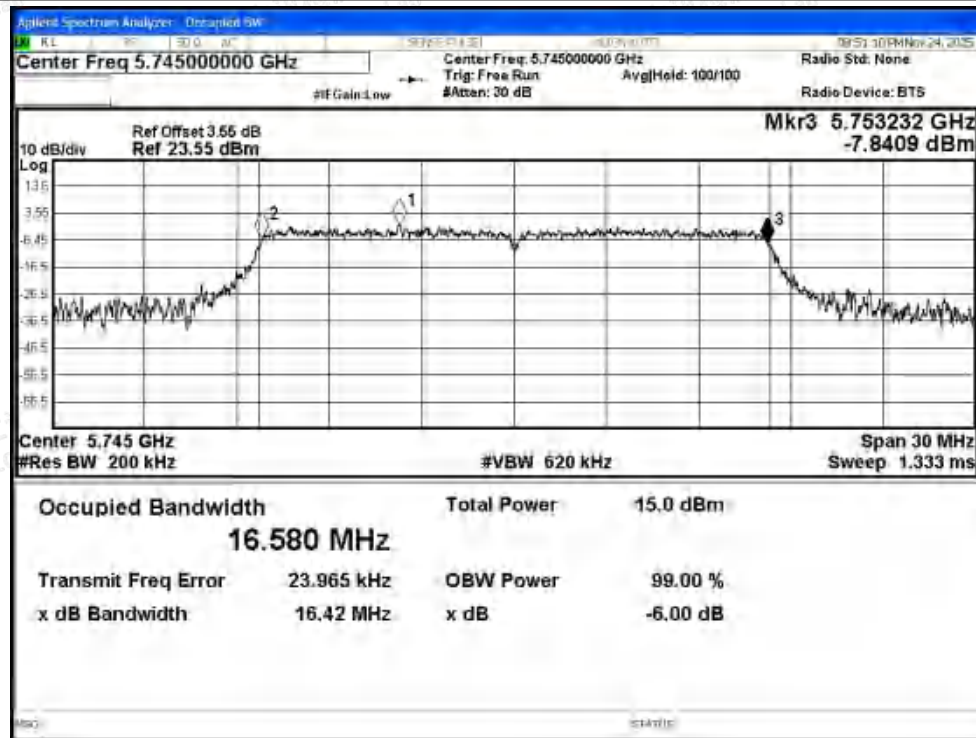

-6dB Bandwidth NVNT a 5785MHz Ant1

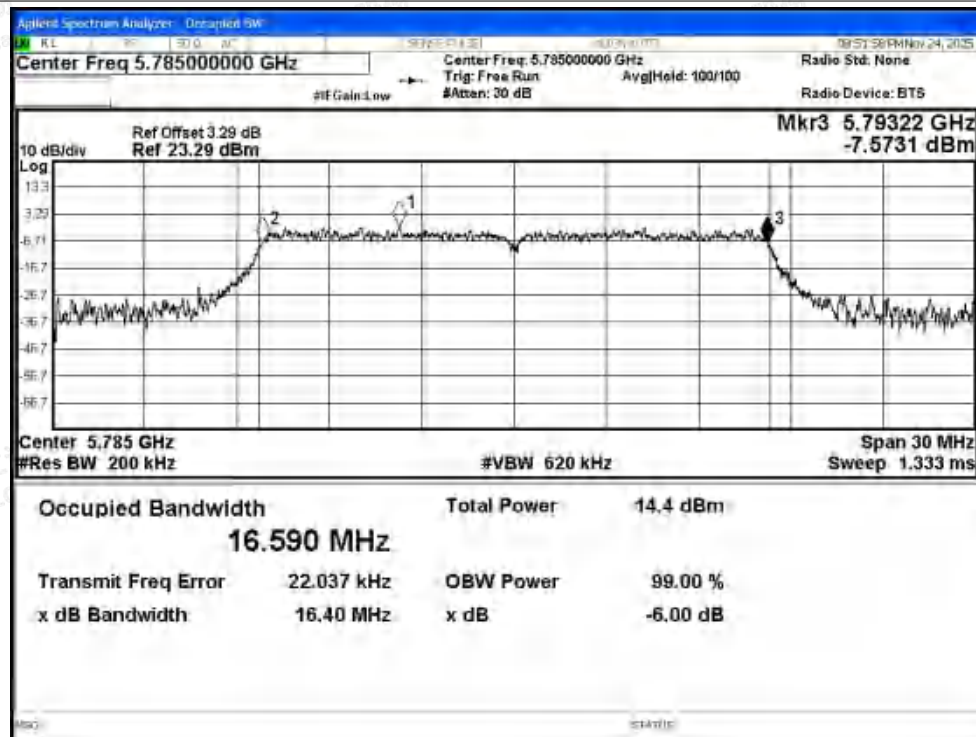

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-6dB Bandwidth NVNT a 5825MHz Ant1

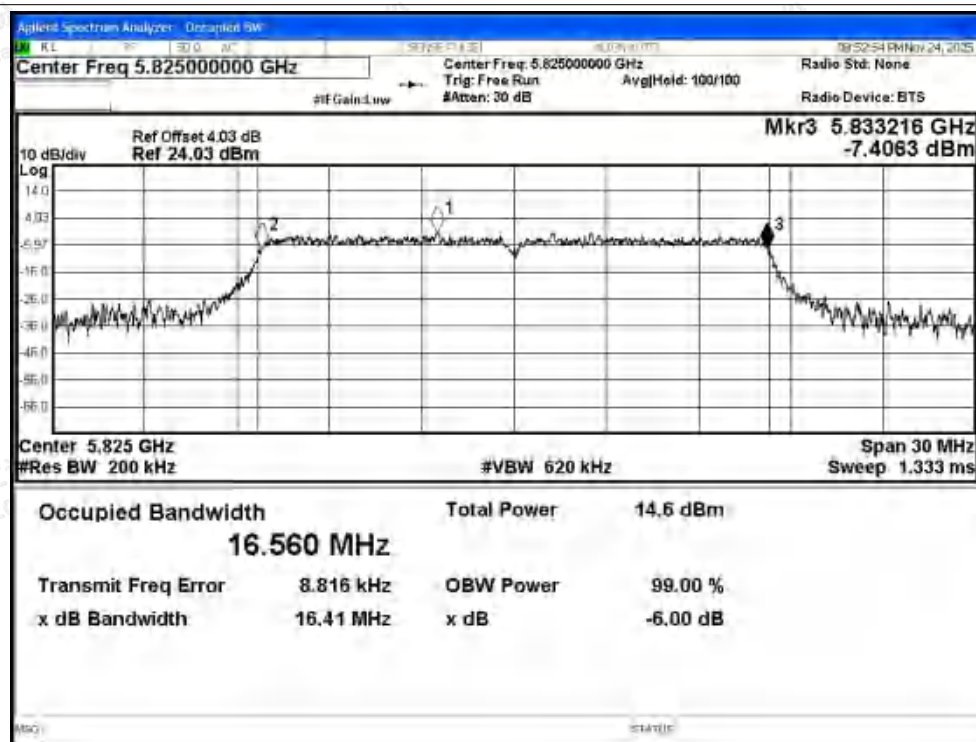

-6dB Bandwidth NVNT n20 5745MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-6dB Bandwidth NVNT n20 5785MHz Ant1



-6dB Bandwidth NVNT n20 5825MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT n40 5755MHz Ant1

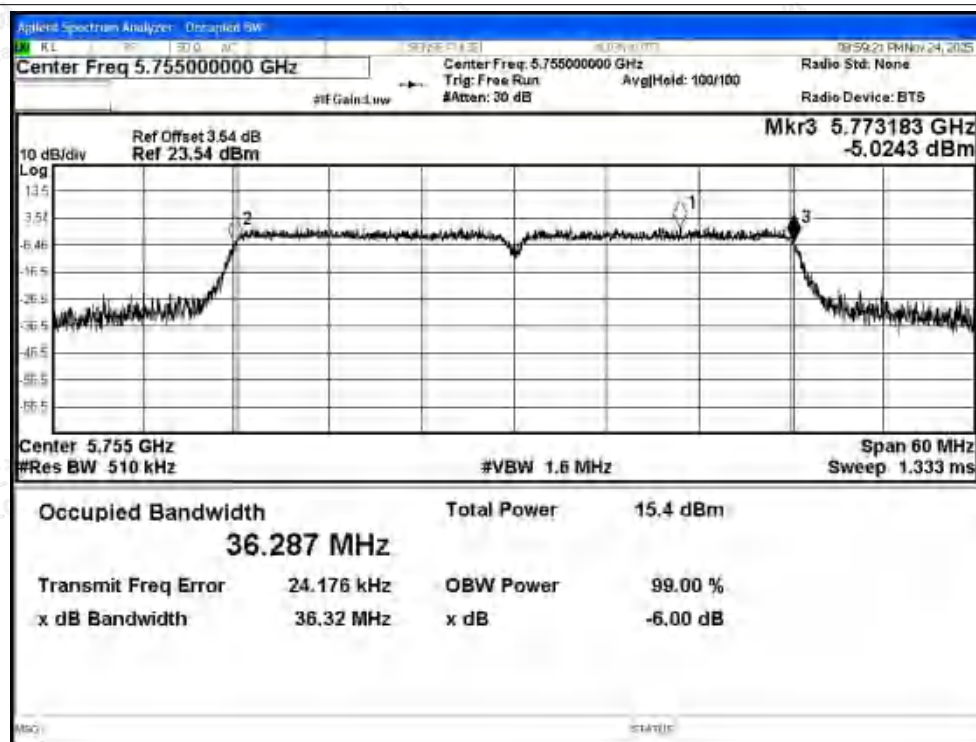

-6dB Bandwidth NVNT n40 5795MHz Ant1

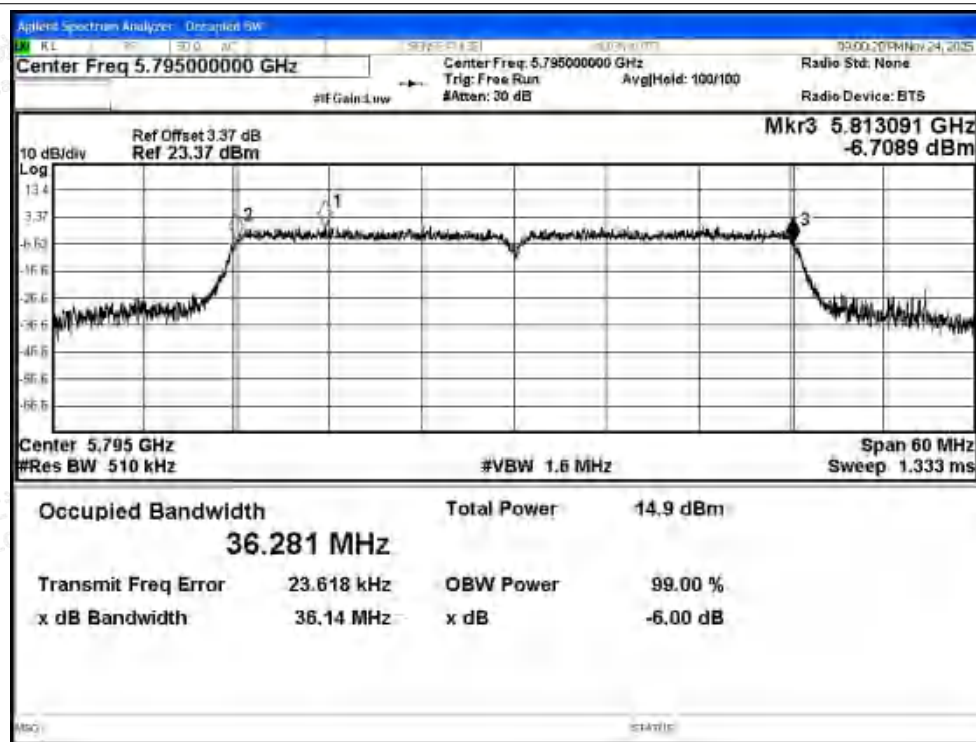

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT ac20 5745MHz Ant1

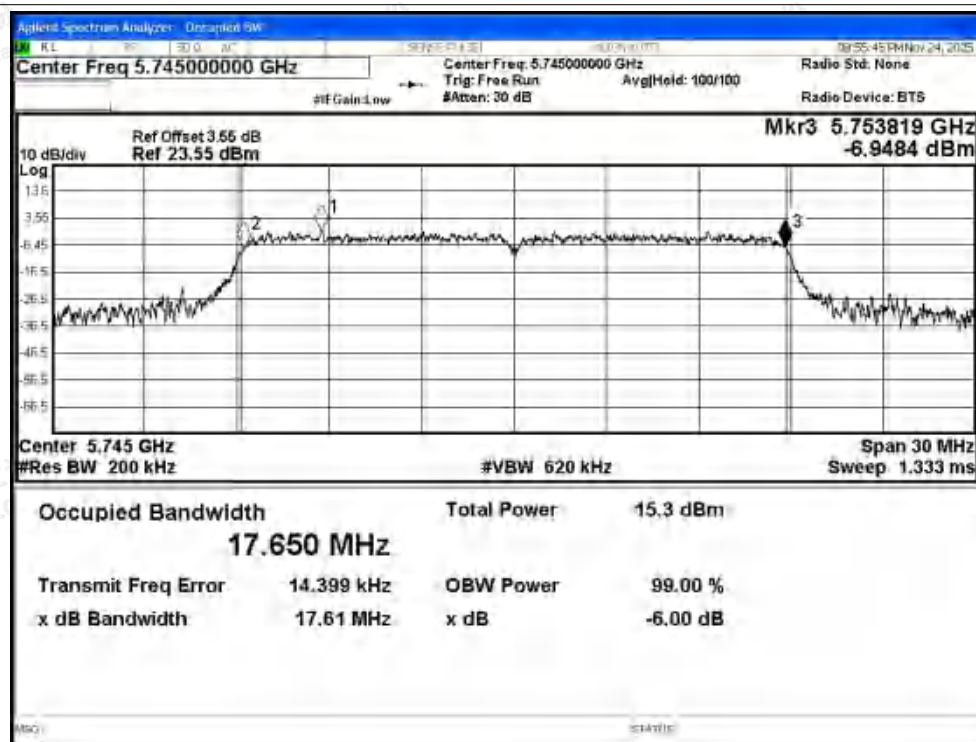

-6dB Bandwidth NVNT ac20 5785MHz Ant1

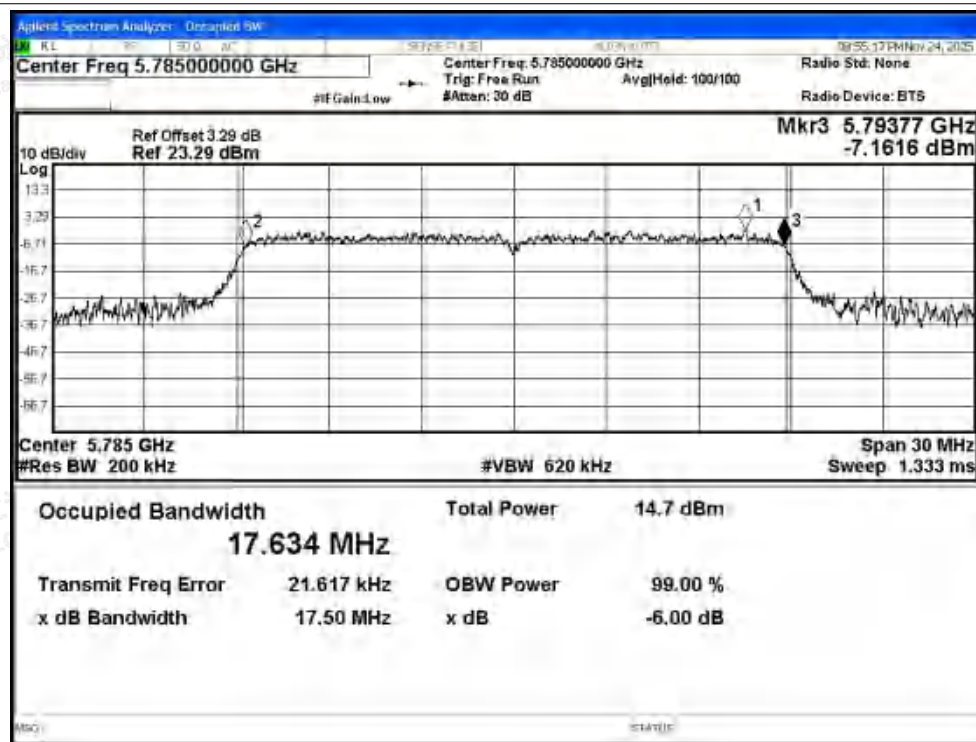

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT ac20 5825MHz Ant1

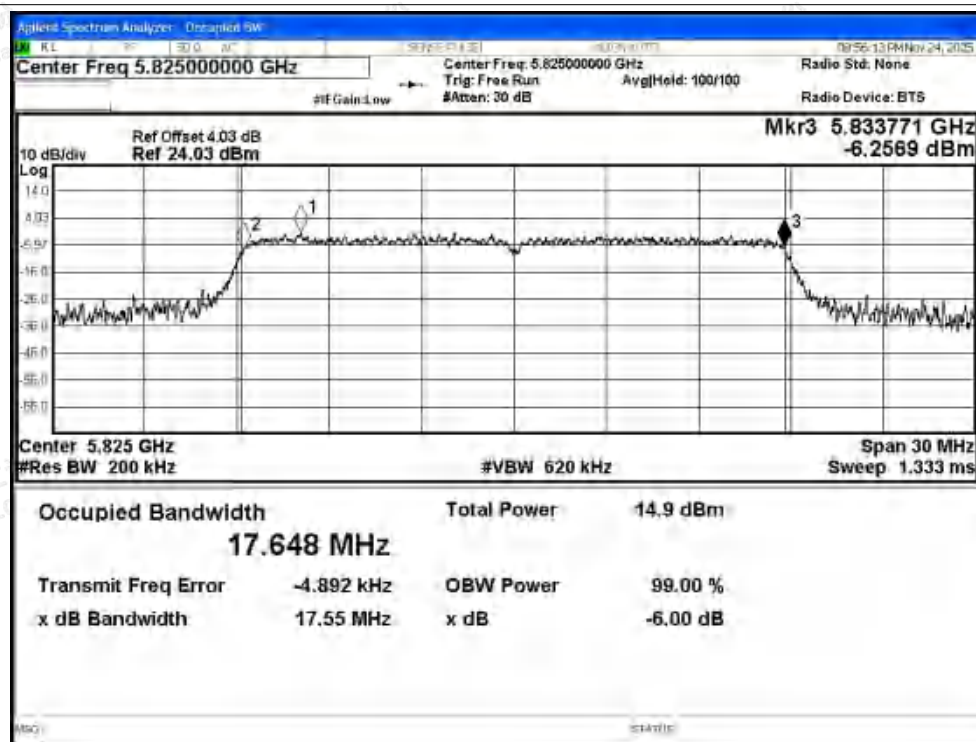

-6dB Bandwidth NVNT ac40 5755MHz Ant1

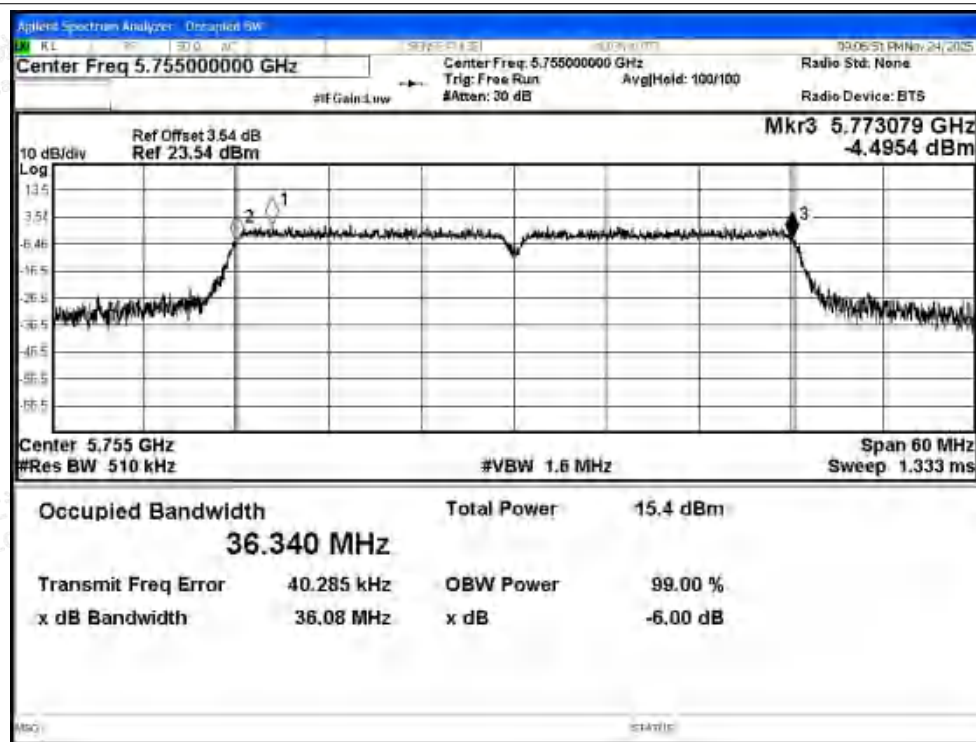

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT ac40 5795MHz Ant1

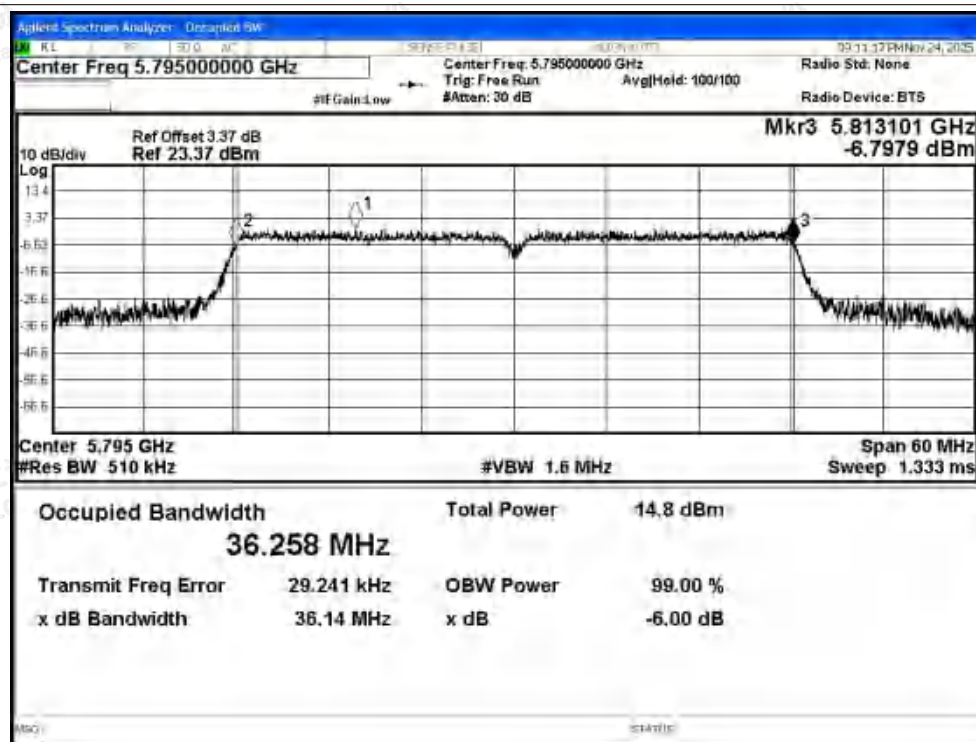

-6dB Bandwidth NVNT ac80 5775MHz Ant1

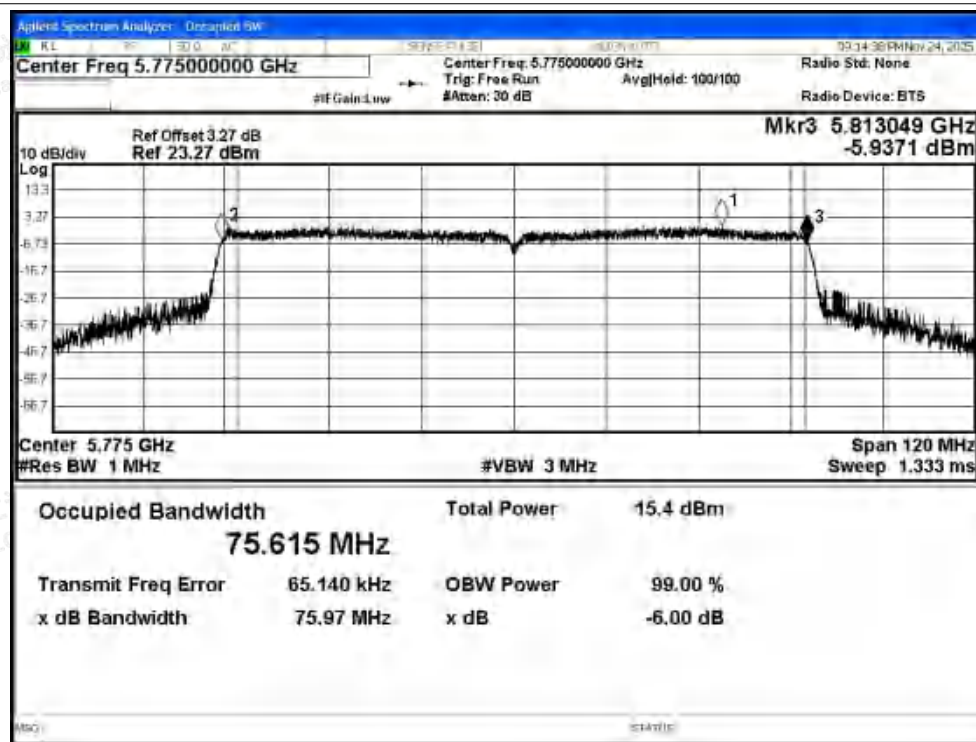

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-6dB Bandwidth NVNT ax20 5745MHz Ant1

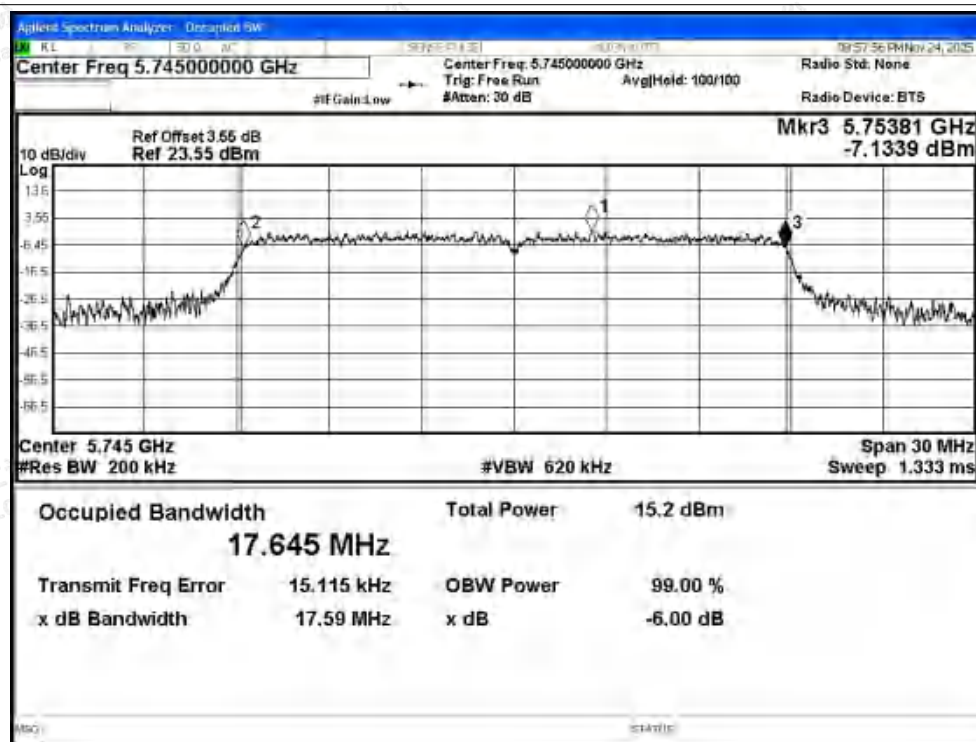

-6dB Bandwidth NVNT ax20 5785MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT ax20 5825MHz Ant1

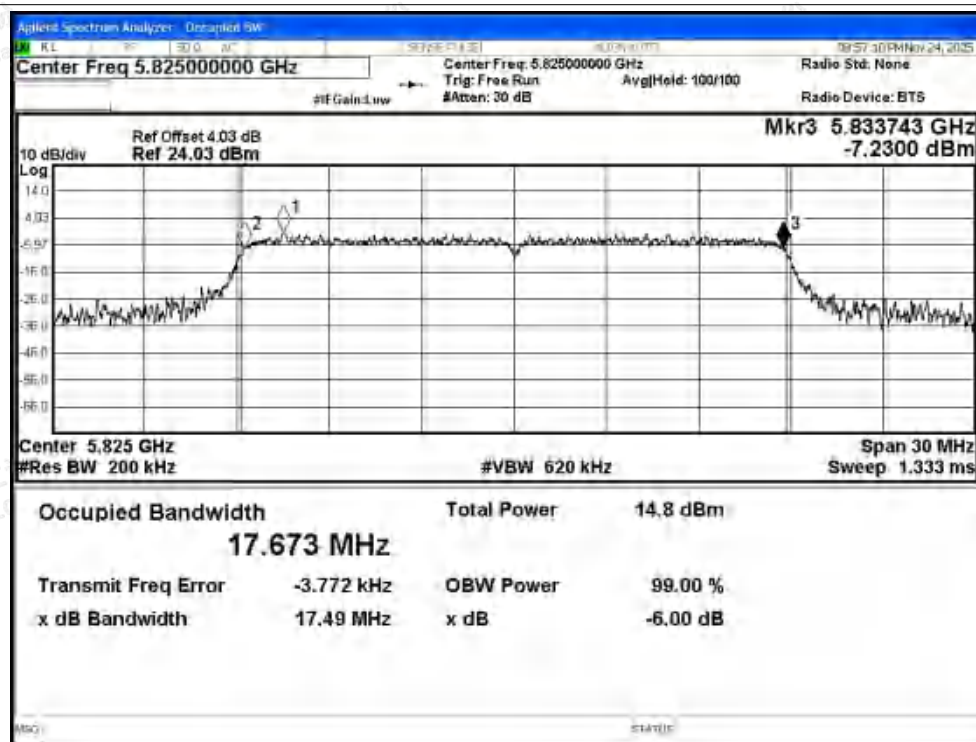

-6dB Bandwidth NVNT ax40 5755MHz Ant1

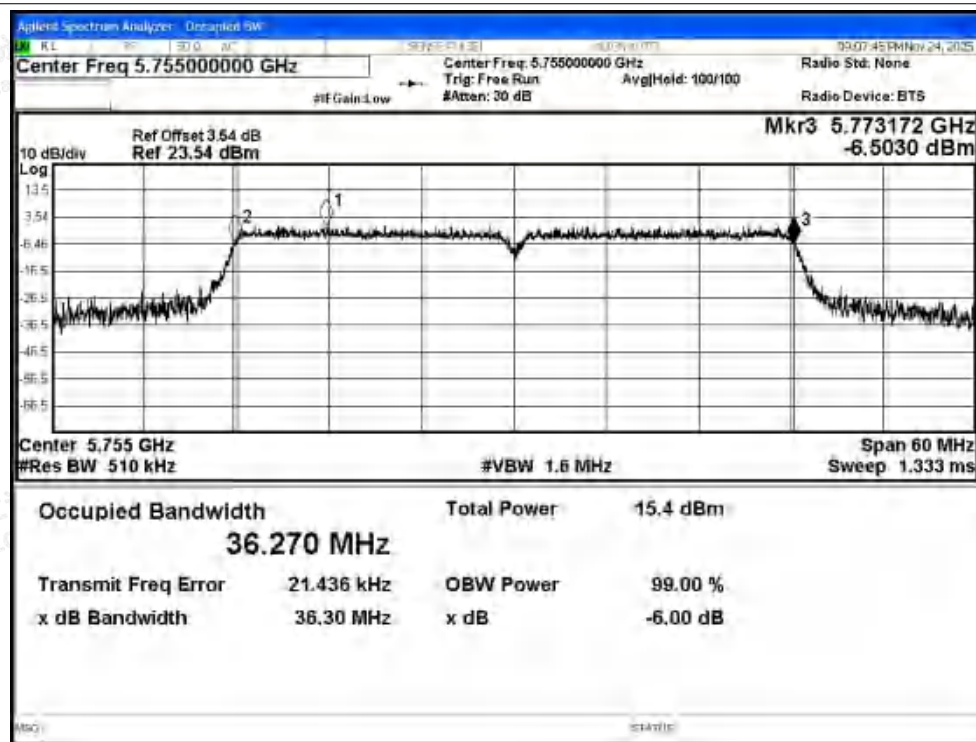

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT ax40 5795MHz Ant1

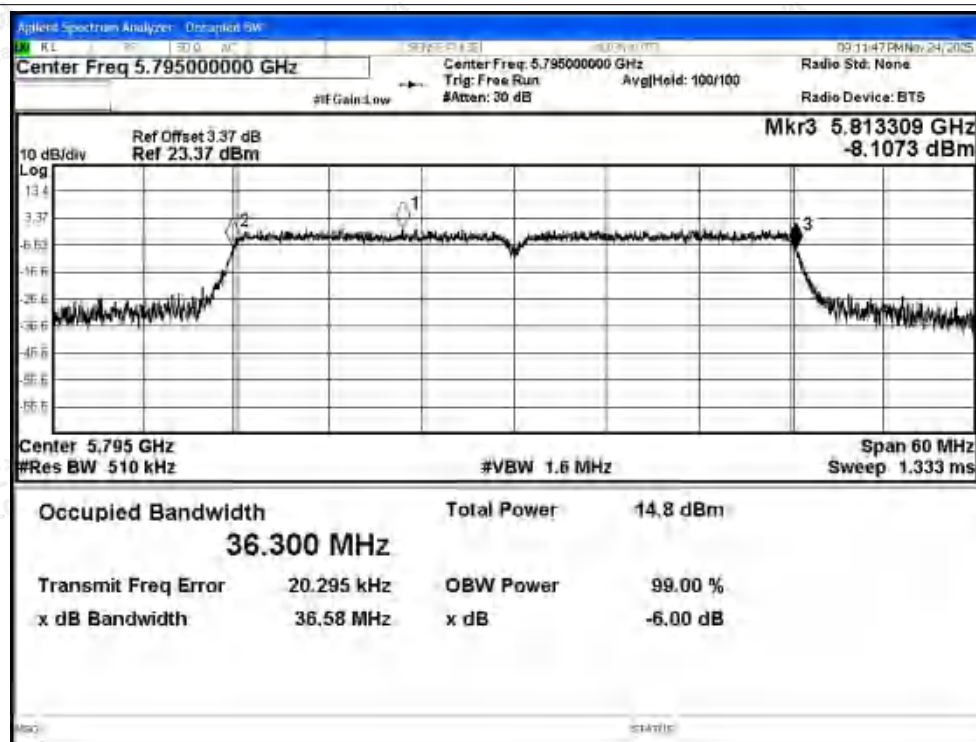

-6dB Bandwidth NVNT ax80 5775MHz Ant1

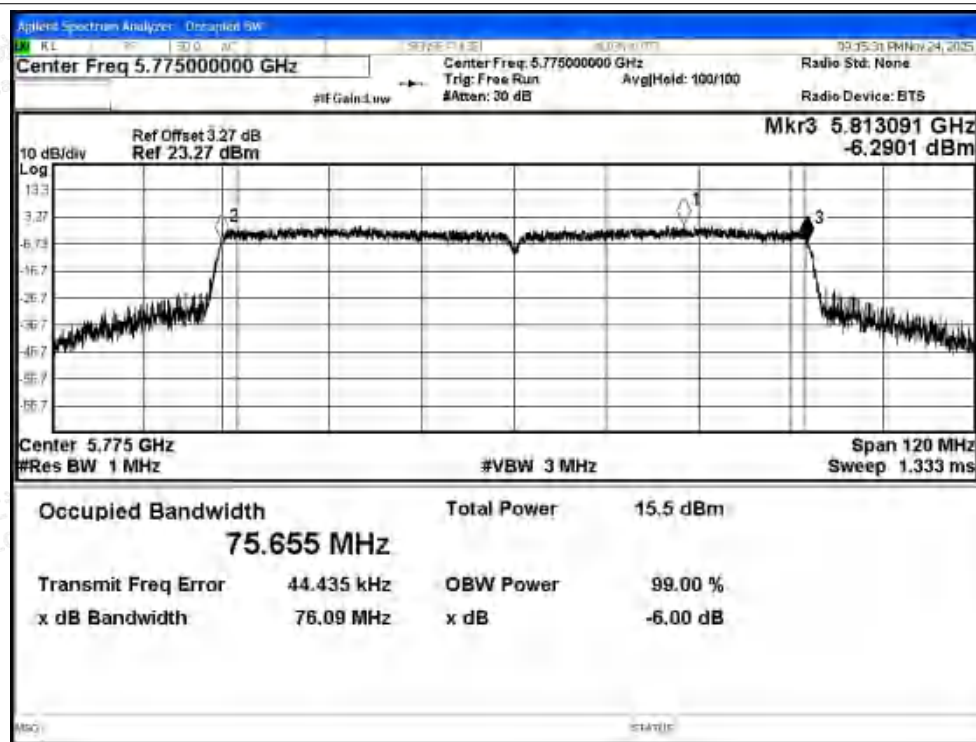


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	-6 dB Bandwidth (MHz)	Limit -6 dB Bandwidth (MHz)	Verdict
NVNT	a	5745	Ant2	16.414	≥ 0.5	Pass
NVNT	a	5785	Ant2	16.445	≥ 0.5	Pass
NVNT	a	5825	Ant2	16.374	≥ 0.5	Pass
NVNT	n20	5745	Ant2	17.546	≥ 0.5	Pass
NVNT	n20	5785	Ant2	17.585	≥ 0.5	Pass
NVNT	n20	5825	Ant2	17.511	≥ 0.5	Pass
NVNT	n40	5755	Ant2	36.247	≥ 0.5	Pass
NVNT	n40	5795	Ant2	36.229	≥ 0.5	Pass
NVNT	ac20	5745	Ant2	17.49	≥ 0.5	Pass
NVNT	ac20	5785	Ant2	17.604	≥ 0.5	Pass
NVNT	ac20	5825	Ant2	17.609	≥ 0.5	Pass
NVNT	ac40	5755	Ant2	36.127	≥ 0.5	Pass
NVNT	ac40	5795	Ant2	36.316	≥ 0.5	Pass
NVNT	ac80	5775	Ant2	76.209	≥ 0.5	Pass
NVNT	ax20	5745	Ant2	17.575	≥ 0.5	Pass
NVNT	ax20	5785	Ant2	17.57	≥ 0.5	Pass
NVNT	ax20	5825	Ant2	17.572	≥ 0.5	Pass
NVNT	ax40	5755	Ant2	36.147	≥ 0.5	Pass
NVNT	ax40	5795	Ant2	36.343	≥ 0.5	Pass
NVNT	ax80	5775	Ant2	76.144	≥ 0.5	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

-6dB Bandwidth NVNT a 5745MHz Ant2

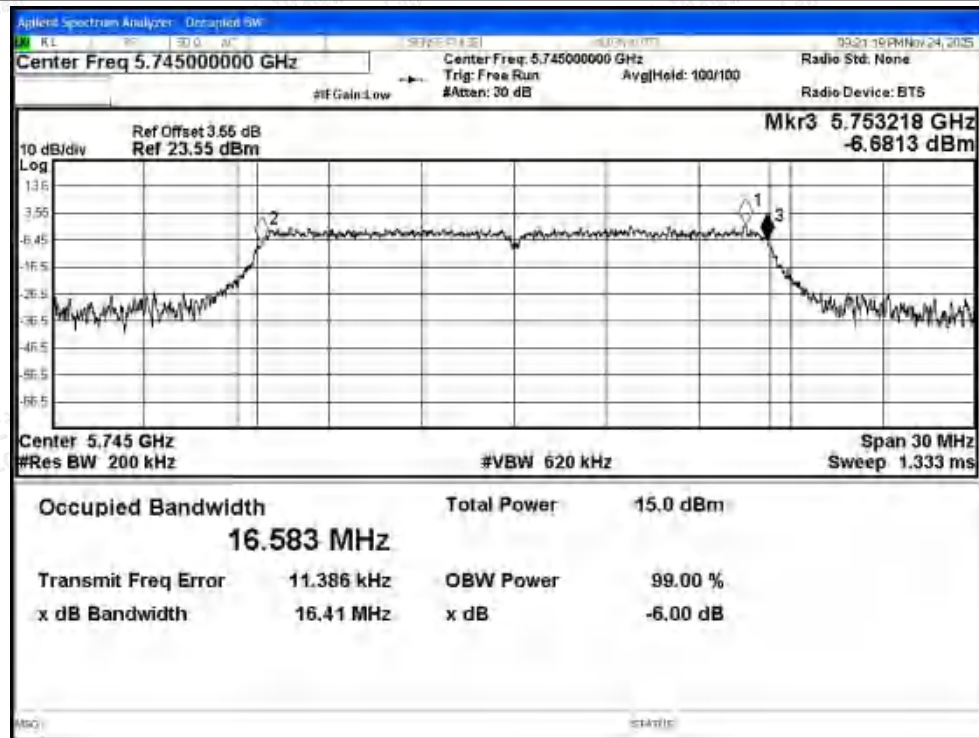

-6dB Bandwidth NVNT a 5785MHz Ant2

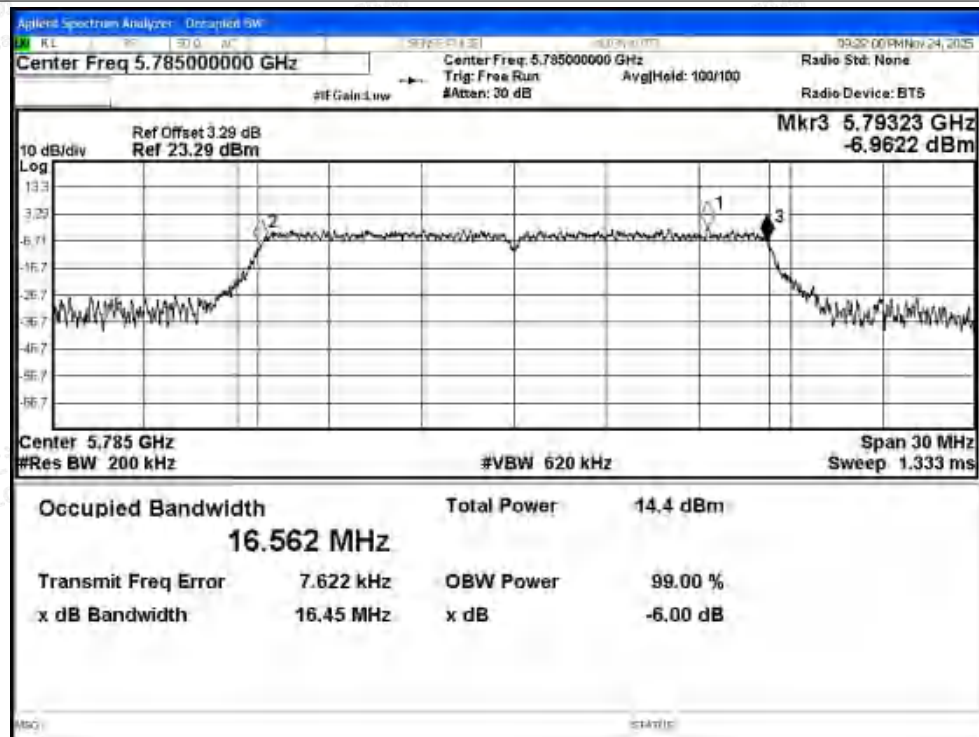

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



-6dB Bandwidth NVNT a 5825MHz Ant2

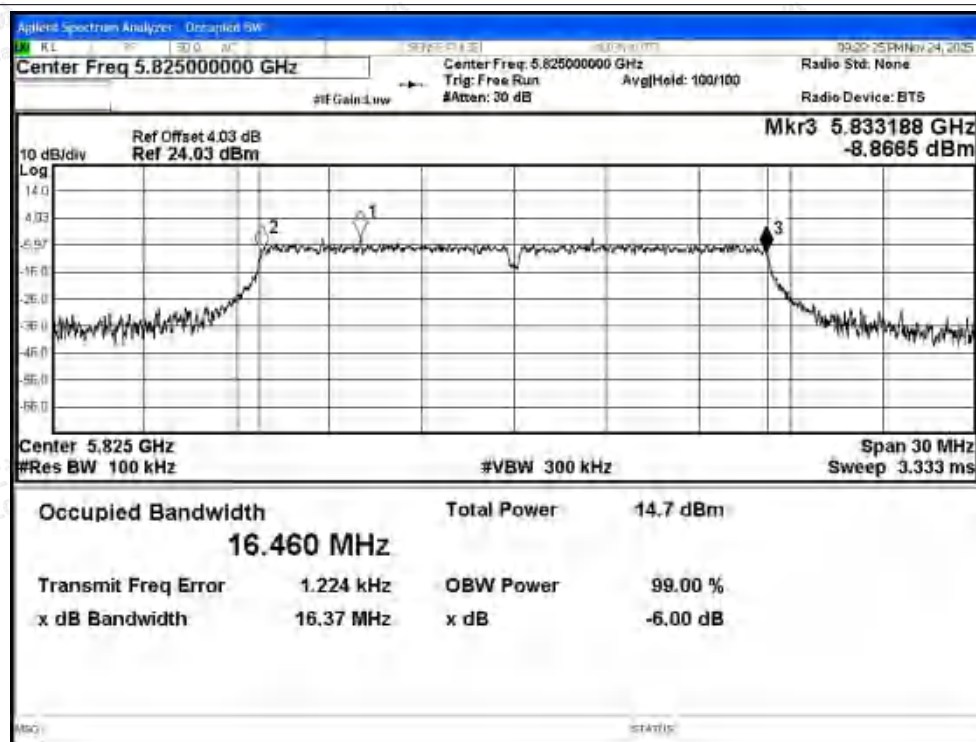

-6dB Bandwidth NVNT n20 5745MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT n20 5785MHz Ant2

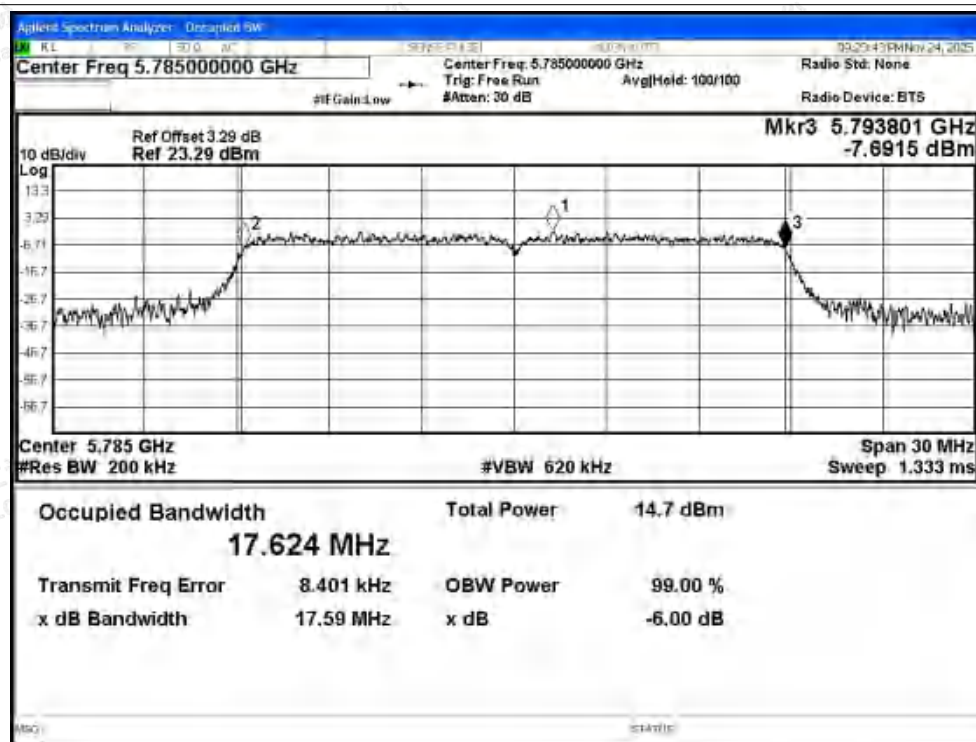

-6dB Bandwidth NVNT n20 5825MHz Ant2

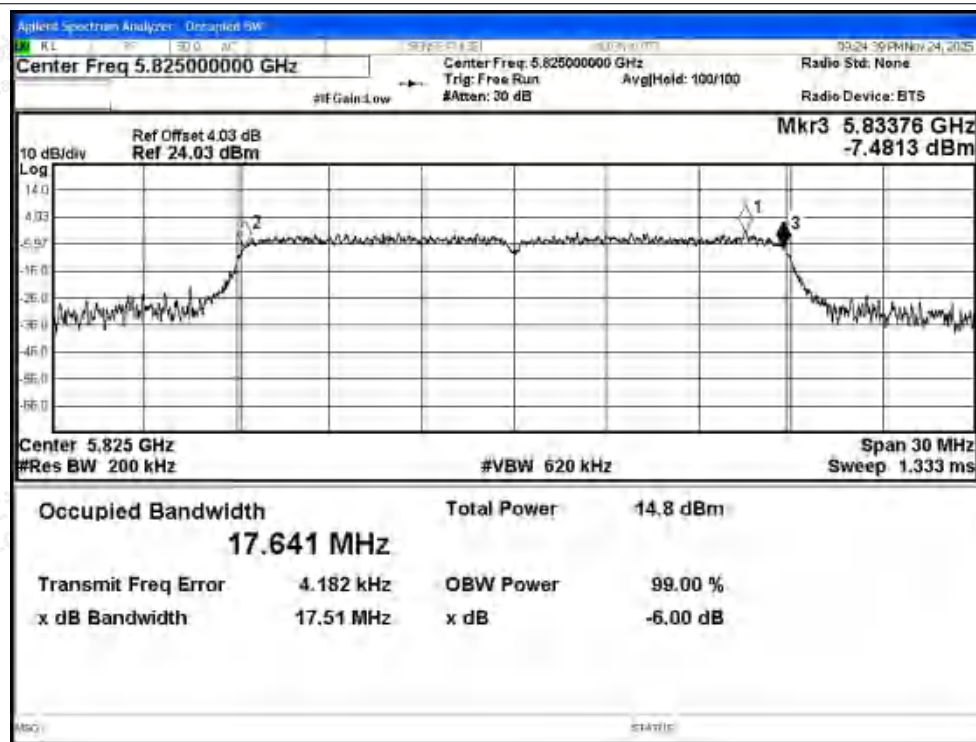

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT n40 5755MHz Ant2

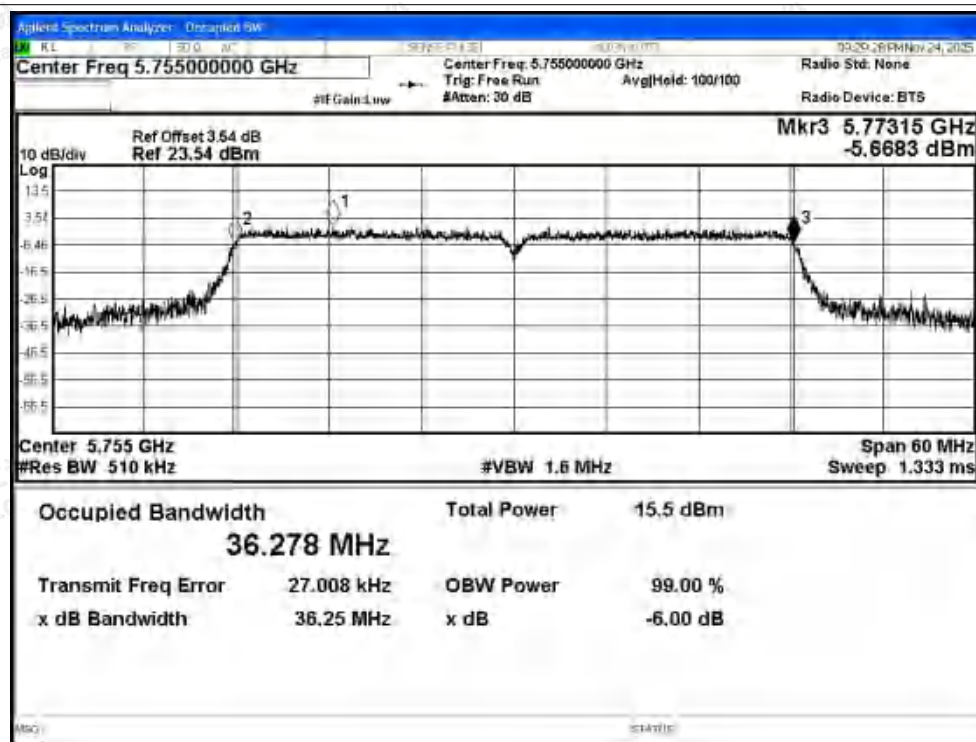

-6dB Bandwidth NVNT n40 5795MHz Ant2

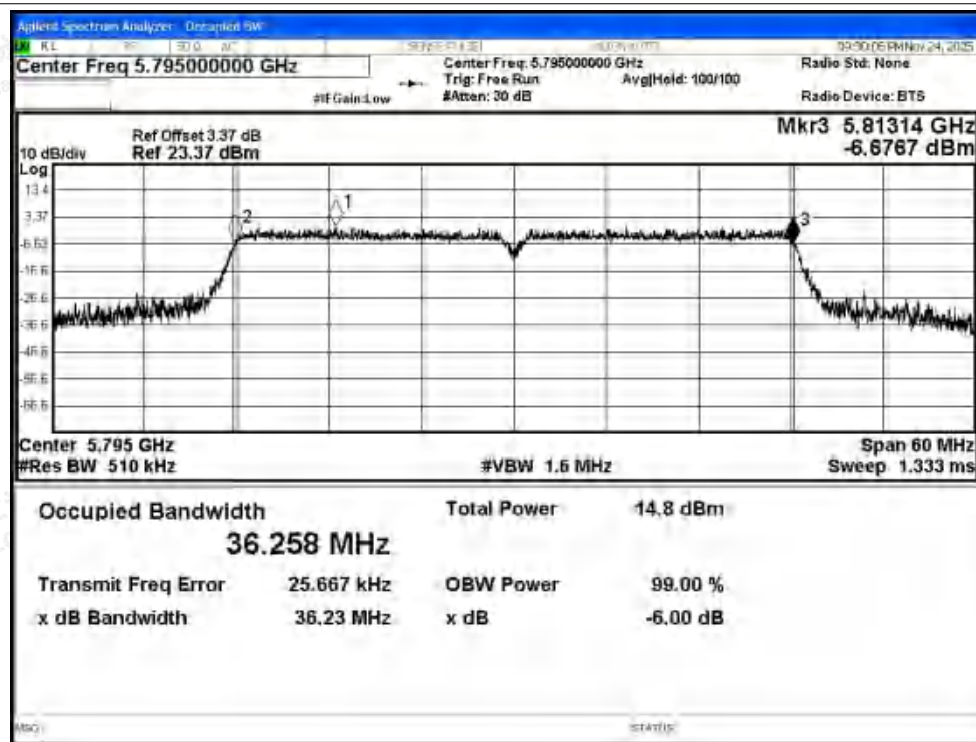

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT ac20 5745MHz Ant2

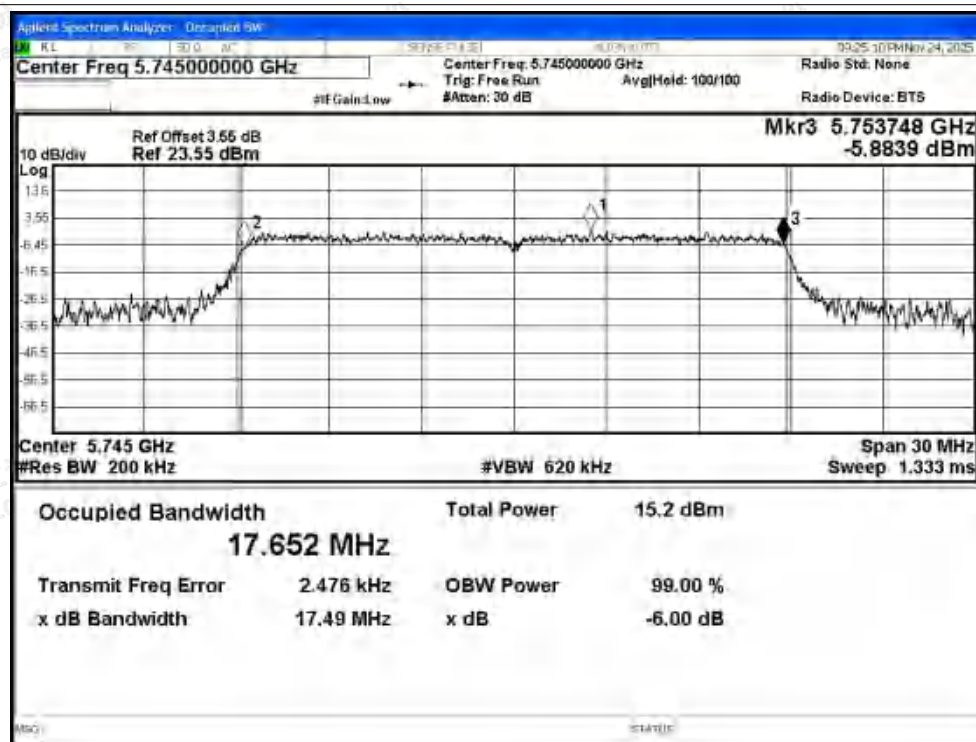

-6dB Bandwidth NVNT ac20 5785MHz Ant2

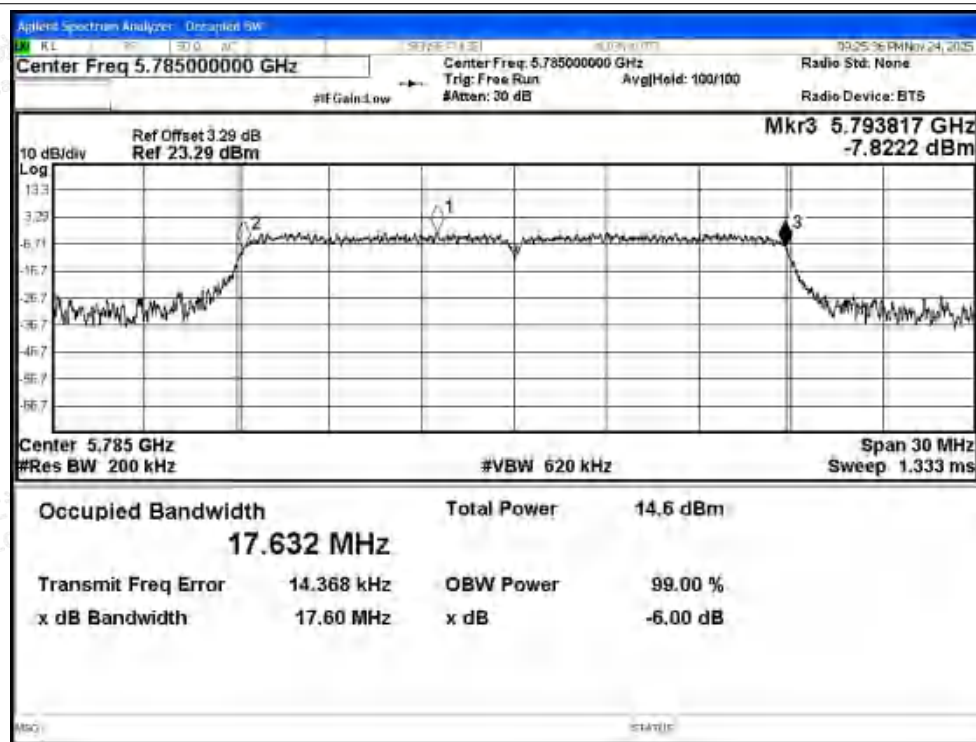

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT ac20 5825MHz Ant2

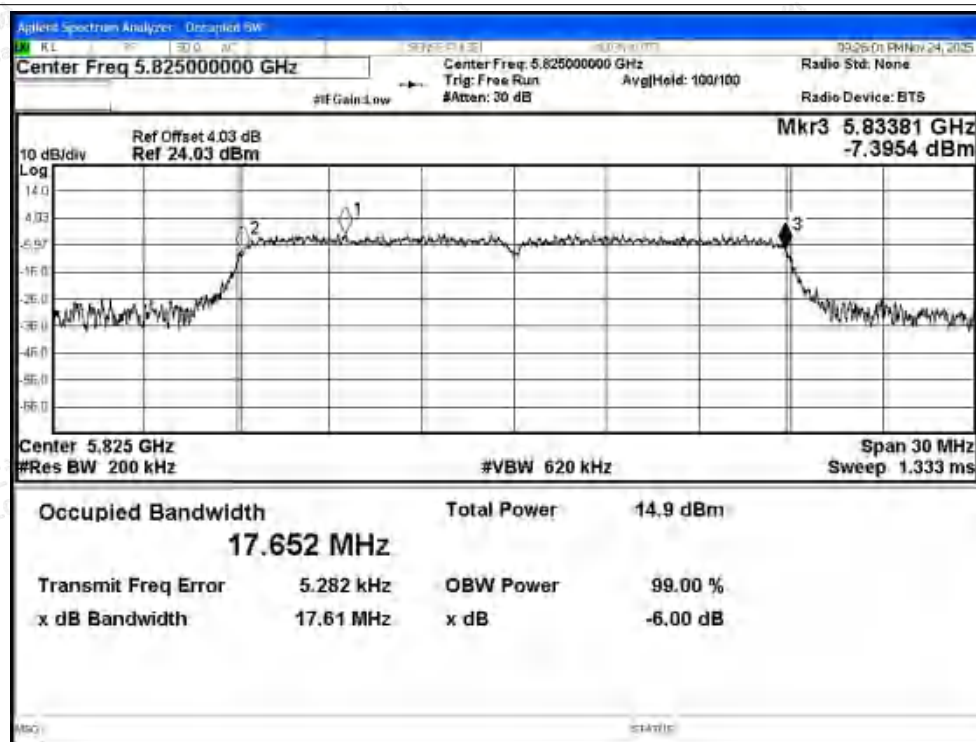

-6dB Bandwidth NVNT ac40 5755MHz Ant2

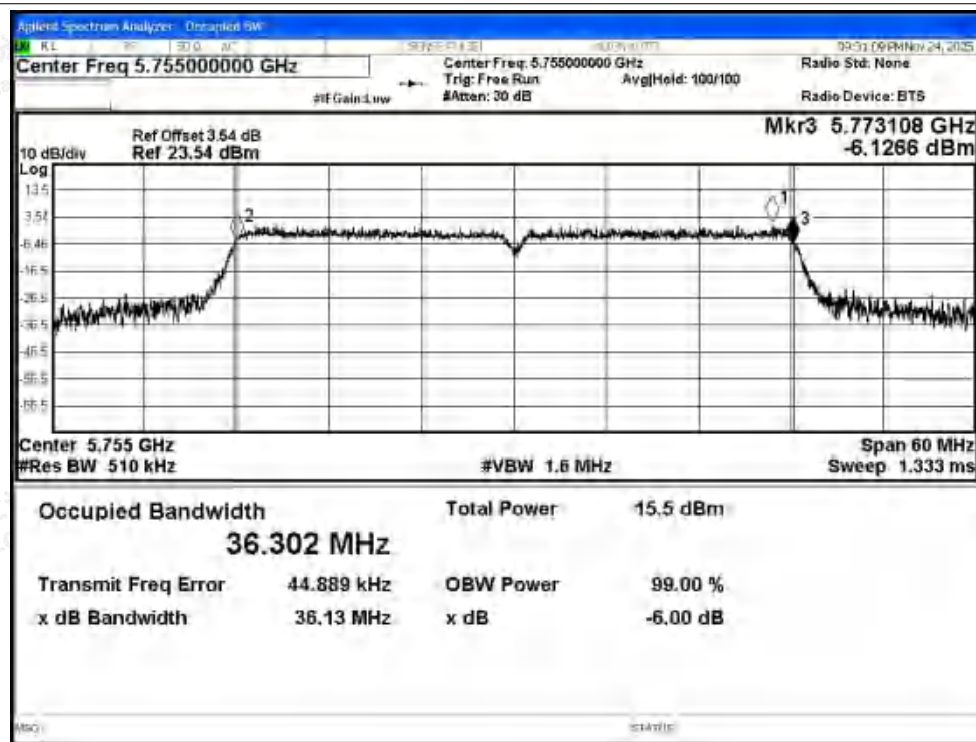

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT ac40 5795MHz Ant2

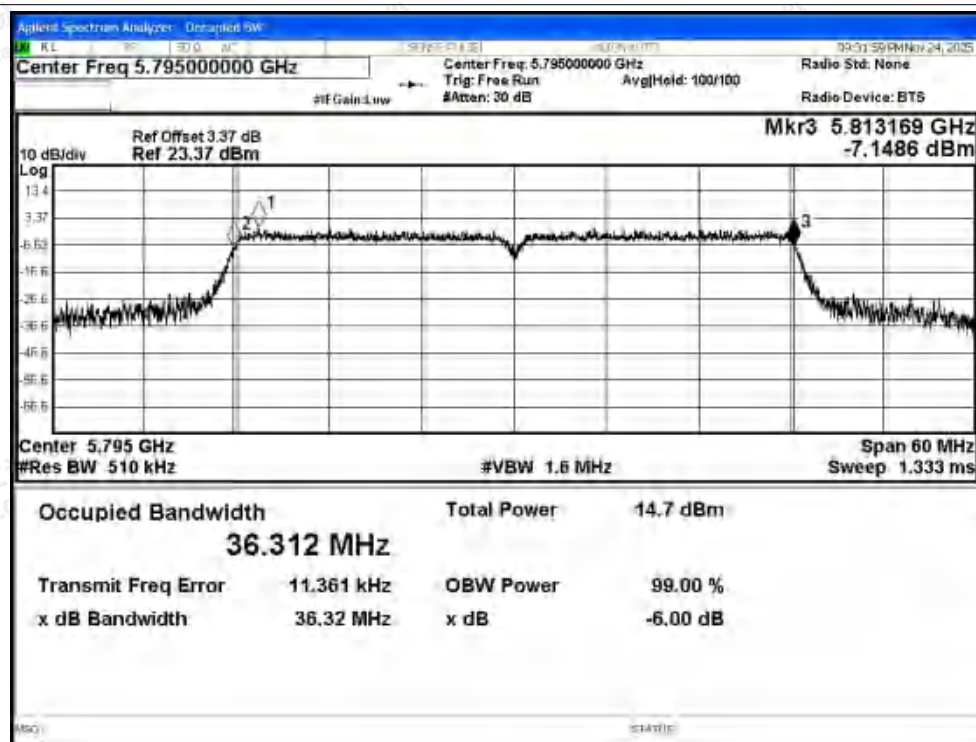

-6dB Bandwidth NVNT ac80 5775MHz Ant2

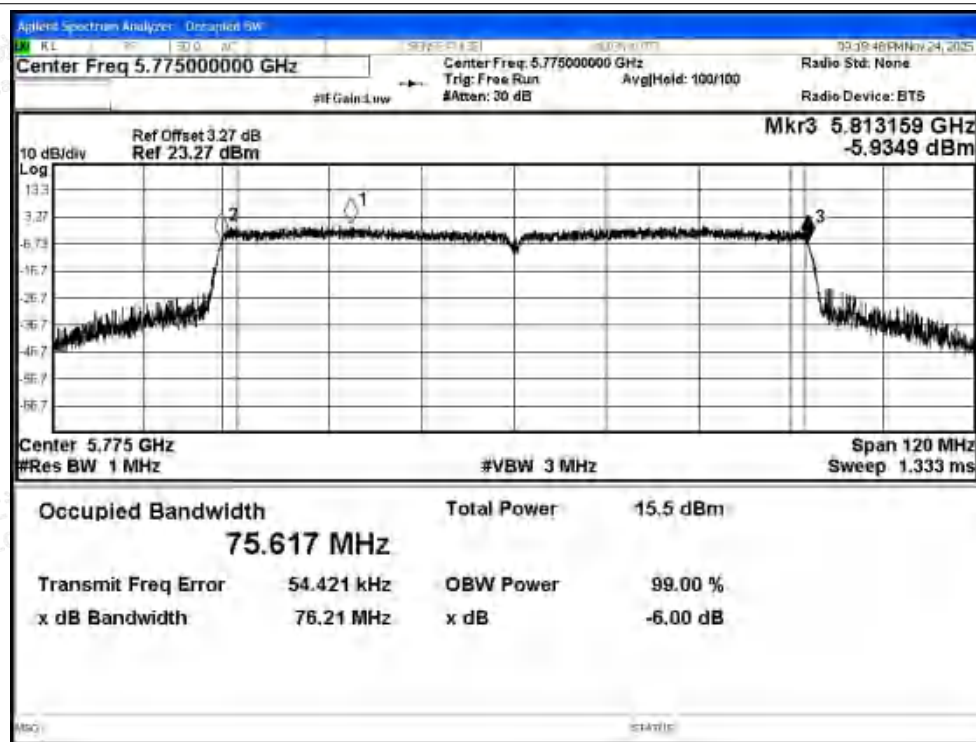

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT ax20 5745MHz Ant2

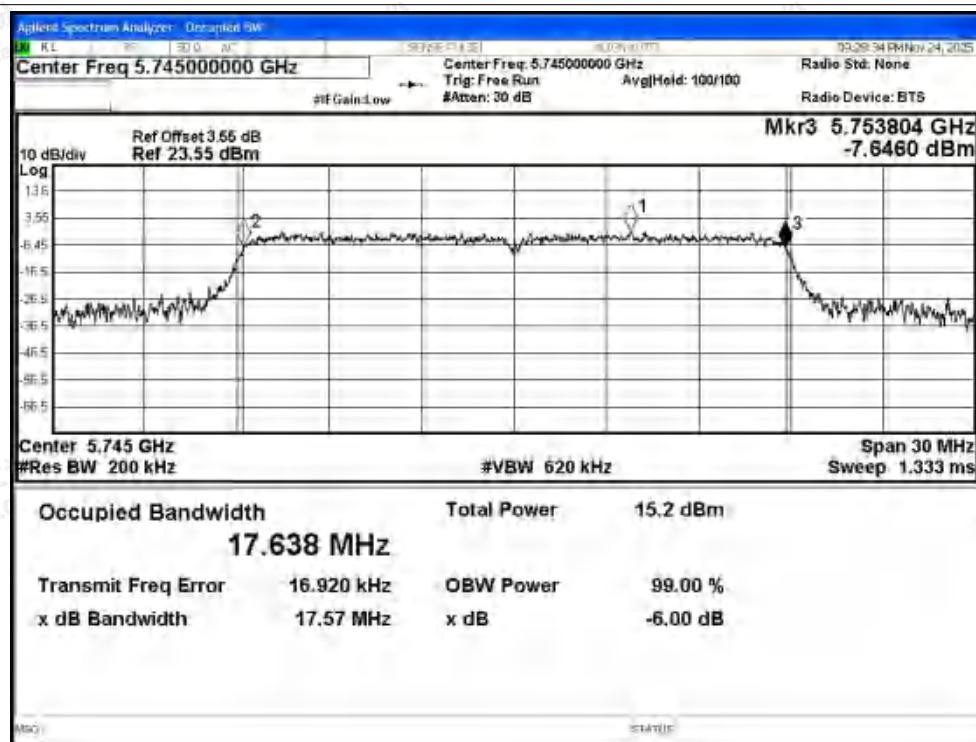

-6dB Bandwidth NVNT ax20 5785MHz Ant2

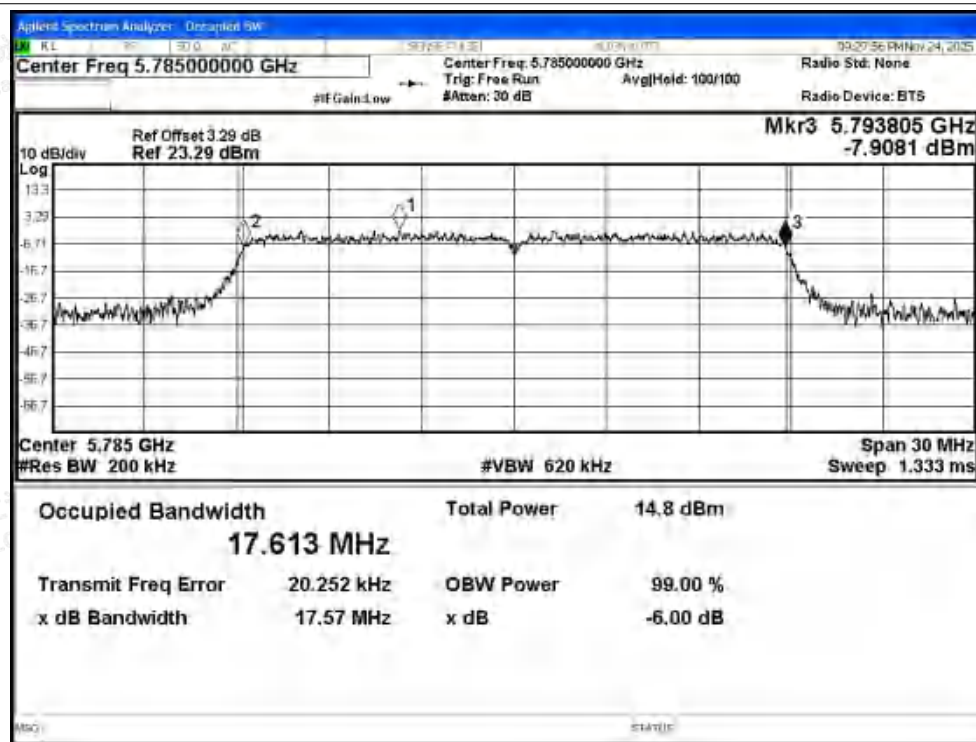

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT ax20 5825MHz Ant2

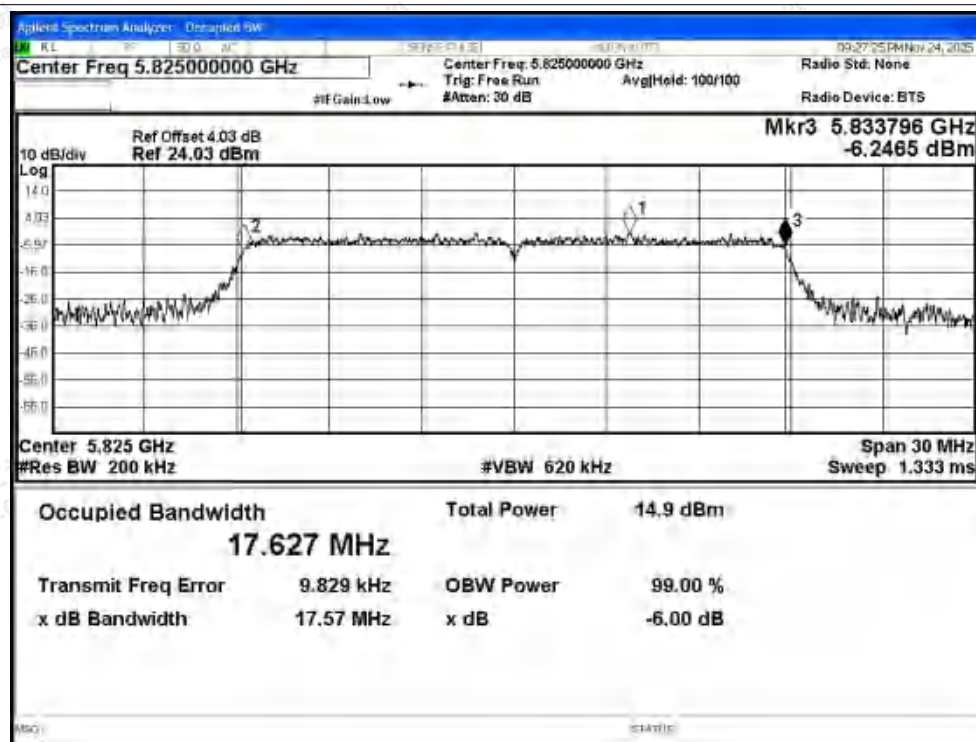

-6dB Bandwidth NVNT ax40 5755MHz Ant2

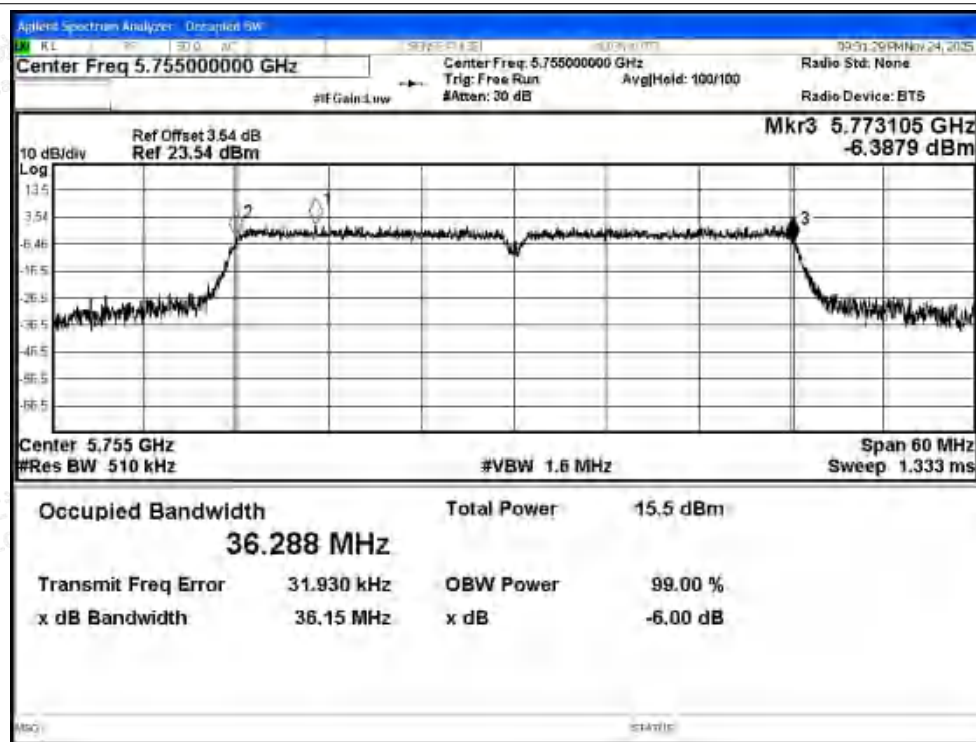

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



-6dB Bandwidth NVNT ax40 5795MHz Ant2

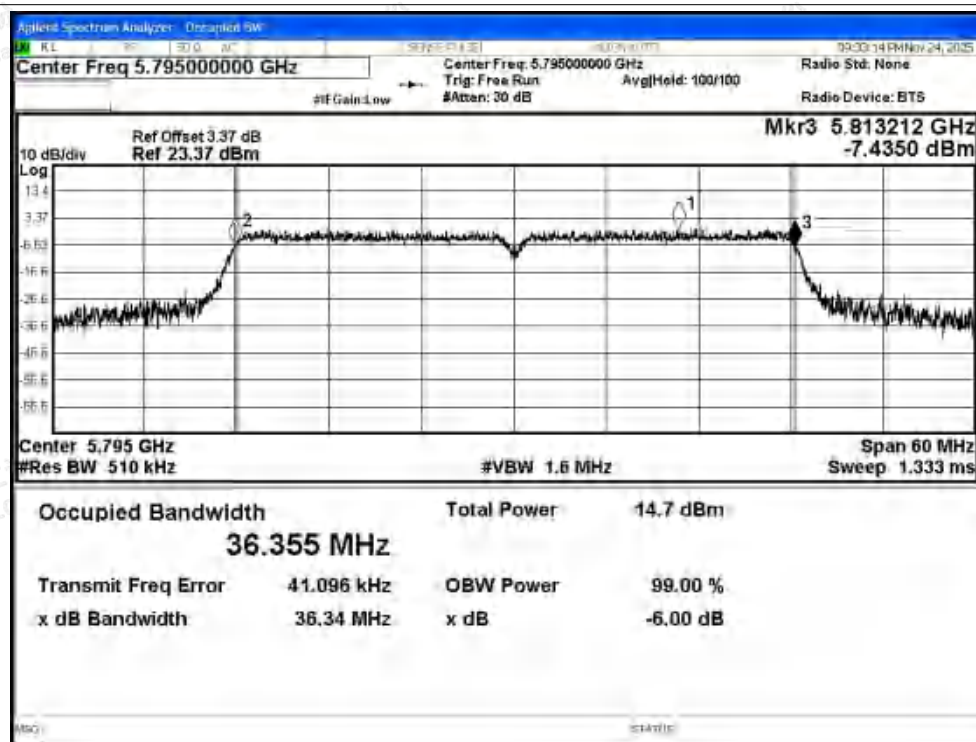

-6dB Bandwidth NVNT ax80 5775MHz Ant2

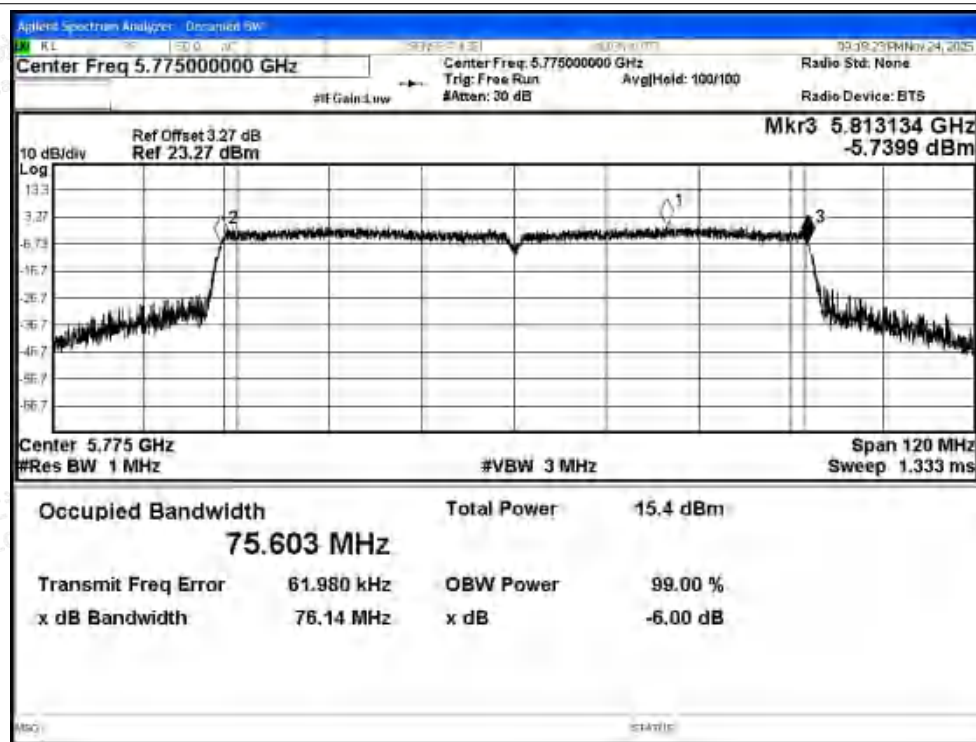


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.2 Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5745	Ant1	17.05	0.1	17.15	30	Pass
NVNT	a	5785	Ant1	17.66	0.11	17.77	30	Pass
NVNT	a	5825	Ant1	17.6	0.1	17.70	30	Pass
NVNT	n20	5745	Ant1	16.92	0.11	17.03	30	Pass
NVNT	n20	5785	Ant1	16.49	0.11	16.60	30	Pass
NVNT	n20	5825	Ant1	16.46	0.11	16.57	30	Pass
NVNT	n40	5755	Ant1	16.3	0.23	16.53	30	Pass
NVNT	n40	5795	Ant1	16.96	0.22	17.18	30	Pass
NVNT	ac20	5745	Ant1	16.88	0.11	16.99	30	Pass
NVNT	ac20	5785	Ant1	16.5	0.11	16.61	30	Pass
NVNT	ac20	5825	Ant1	16.35	0.11	16.46	30	Pass
NVNT	ac40	5755	Ant1	16.3	0.22	16.52	30	Pass
NVNT	ac40	5795	Ant1	16.36	0.23	16.59	30	Pass
NVNT	ac80	5775	Ant1	16.25	0.43	16.68	30	Pass
NVNT	ax20	5745	Ant1	16.46	0.11	16.57	30	Pass
NVNT	ax20	5785	Ant1	16.97	0.11	17.08	30	Pass
NVNT	ax20	5825	Ant1	16.89	0.11	17.00	30	Pass
NVNT	ax40	5755	Ant1	16.16	0.21	16.37	30	Pass
NVNT	ax40	5795	Ant1	16.94	0.22	17.16	30	Pass
NVNT	ax80	5775	Ant1	15.26	0.43	15.69	30	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5745	Ant2	17.04	0.1	17.14	30	Pass
NVNT	a	5785	Ant2	17.17	0.1	17.27	30	Pass
NVNT	a	5825	Ant2	17.11	0.1	17.21	30	Pass
NVNT	n20	5745	Ant2	16.33	0.11	16.44	30	Pass
NVNT	n20	5785	Ant2	16.05	0.11	16.16	30	Pass
NVNT	n20	5825	Ant2	16.5	0.11	16.61	30	Pass
NVNT	n40	5755	Ant2	16.28	0.22	16.5	30	Pass
NVNT	n40	5795	Ant2	16.8	0.22	17.02	30	Pass
NVNT	ac20	5745	Ant2	16.36	0.11	16.47	30	Pass
NVNT	ac20	5785	Ant2	16.02	0.11	16.13	30	Pass
NVNT	ac20	5825	Ant2	16.96	0.11	17.07	30	Pass
NVNT	ac40	5755	Ant2	16.24	0.21	16.45	30	Pass
NVNT	ac40	5795	Ant2	16.9	0.22	17.12	30	Pass
NVNT	ac80	5775	Ant2	16.34	0.43	16.77	30	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5745	Ant2	16.33	0.11	16.44	30	Pass
NVNT	ax20	5785	Ant2	16.89	0.11	17.0	30	Pass
NVNT	ax20	5825	Ant2	16.92	0.11	17.03	30	Pass
NVNT	ax40	5755	Ant2	16.26	0.21	16.47	30	Pass
NVNT	ax40	5795	Ant2	16.87	0.21	17.08	30	Pass
NVNT	ax80	5775	Ant2	16.32	0.43	16.75	30	Pass

MIMO

Condition	Mode	Frequency (MHz)	Total Power (dBm)			Limit (dBm)	Verdict
			Ant1	Ant2	Ant1+Ant2		
NVNT	n20	5745	17.03	16.44	19.76	30	Pass
NVNT	n20	5785	16.60	16.16	19.40	30	Pass
NVNT	n20	5825	16.57	16.61	19.60	30	Pass
NVNT	n40	5755	16.53	16.5	19.53	30	Pass
NVNT	n40	5795	17.18	17.02	20.11	30	Pass
NVNT	ac20	5745	16.99	16.47	19.75	30	Pass
NVNT	ac20	5785	16.61	16.13	19.39	30	Pass
NVNT	ac20	5825	16.46	17.07	19.79	30	Pass
NVNT	ac40	5755	16.52	16.45	19.50	30	Pass
NVNT	ac40	5795	16.59	17.12	19.87	30	Pass
NVNT	ac80	5775	16.68	16.77	19.74	30	Pass
NVNT	ax20	5745	16.57	16.44	19.52	30	Pass
NVNT	ax20	5785	17.08	17.0	20.05	30	Pass
NVNT	ax20	5825	17.00	17.03	20.03	30	Pass
NVNT	ax40	5755	16.37	16.47	19.43	30	Pass
NVNT	ax40	5795	17.16	17.08	20.13	30	Pass
NVNT	ax80	5775	15.69	16.75	19.26	30	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.3 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/500KHz)	Duty Factor (dB)	Total PSD (dBm/500KHz)	Limit (dBm/500KHz)	Verdict
NVNT	a	5745	Ant1	1.39	0.1	1.49	30	Pass
NVNT	a	5785	Ant1	1.28	0.11	1.39	30	Pass
NVNT	a	5825	Ant1	1.91	0.1	2.01	30	Pass
NVNT	n20	5745	Ant1	1.23	0.11	1.34	30	Pass
NVNT	n20	5785	Ant1	0.7	0.11	0.81	30	Pass
NVNT	n20	5825	Ant1	1.89	0.11	2.00	30	Pass
NVNT	n40	5755	Ant1	-2.77	0.23	-2.54	30	Pass
NVNT	n40	5795	Ant1	-2.62	0.22	-2.40	30	Pass
NVNT	ac20	5745	Ant1	0.03	0.11	0.14	30	Pass
NVNT	ac20	5785	Ant1	-0.07	0.11	0.04	30	Pass
NVNT	ac20	5825	Ant1	0.72	0.11	0.83	30	Pass
NVNT	ac40	5755	Ant1	-2.19	0.22	-1.97	30	Pass
NVNT	ac40	5795	Ant1	-2.87	0.23	-2.64	30	Pass
NVNT	ac80	5775	Ant1	-6.43	0.43	-6.00	30	Pass
NVNT	ax20	5745	Ant1	0.72	0.11	0.83	30	Pass
NVNT	ax20	5785	Ant1	0.18	0.11	0.29	30	Pass
NVNT	ax20	5825	Ant1	1.15	0.11	1.26	30	Pass
NVNT	ax40	5755	Ant1	-2.49	0.21	-2.28	30	Pass
NVNT	ax40	5795	Ant1	-2.96	0.22	-2.74	30	Pass
NVNT	ax80	5775	Ant1	-6.43	0.43	-6.00	30	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD(dBm/500KHz)	Duty Factor (dB)	Total PSD (dBm/500KHz)	Limit (dBm/500KHz)	Verdict
NVNT	a	5745	Ant2	1.35	0.1	1.45	30	Pass
NVNT	a	5785	Ant2	0.58	0.1	0.68	30	Pass
NVNT	a	5825	Ant2	1.52	0.1	1.62	30	Pass
NVNT	n20	5745	Ant2	0.92	0.11	1.03	30	Pass
NVNT	n20	5785	Ant2	0.37	0.11	0.48	30	Pass
NVNT	n20	5825	Ant2	1.65	0.11	1.76	30	Pass
NVNT	n40	5755	Ant2	-2.4	0.22	-2.18	30	Pass
NVNT	n40	5795	Ant2	-2.76	0.22	-2.54	30	Pass
NVNT	ac20	5745	Ant2	0.71	0.11	0.82	30	Pass
NVNT	ac20	5785	Ant2	0.34	0.11	0.45	30	Pass
NVNT	ac20	5825	Ant2	1.35	0.11	1.46	30	Pass
NVNT	ac40	5755	Ant2	-2.24	0.21	-2.03	30	Pass
NVNT	ac40	5795	Ant2	-2.76	0.22	-2.54	30	Pass
NVNT	ac80	5775	Ant2	-6.55	0.43	-6.12	30	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5745	Ant2	0.63	0.11	0.74	30	Pass
NVNT	ax20	5785	Ant2	0.2	0.11	0.31	30	Pass
NVNT	ax20	5825	Ant2	1.14	0.11	1.25	30	Pass
NVNT	ax40	5755	Ant2	-2.48	0.21	-2.27	30	Pass
NVNT	ax40	5795	Ant2	-2.88	0.21	-2.67	30	Pass
NVNT	ax80	5775	Ant2	-7.36	0.43	-6.93	30	Pass

MIMO

Condition	Mode	Frequency (MHz)	Total PSD (dBm/500KHz)			Limit (dBm/500KHz)	Verdict
			Ant1	Ant2	Ant1+Ant2		
NVNT	n20	5745	1.34	1.03	4.20	27.97	Pass
NVNT	n20	5785	0.81	0.48	3.66	27.97	Pass
NVNT	n20	5825	2.00	1.76	4.89	27.97	Pass
NVNT	n40	5755	-2.54	-2.18	0.65	27.97	Pass
NVNT	n40	5795	-2.40	-2.54	0.54	27.97	Pass
NVNT	ac20	5745	0.14	0.82	3.50	27.97	Pass
NVNT	ac20	5785	0.04	0.45	3.26	27.97	Pass
NVNT	ac20	5825	0.83	1.46	4.17	27.97	Pass
NVNT	ac40	5755	-1.97	-2.03	1.01	27.97	Pass
NVNT	ac40	5795	-2.64	-2.54	0.42	27.97	Pass
NVNT	ac80	5775	-6.00	-6.12	-3.05	27.97	Pass
NVNT	ax20	5745	0.83	0.74	3.80	27.97	Pass
NVNT	ax20	5785	0.29	0.31	3.31	27.97	Pass
NVNT	ax20	5825	1.26	1.25	4.27	27.97	Pass
NVNT	ax40	5755	-2.28	-2.27	0.74	27.97	Pass
NVNT	ax40	5795	-2.74	-2.67	0.31	27.97	Pass
NVNT	ax80	5775	-6.00	-6.93	-3.43	27.97	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

PSD NVNT a 5745MHz Ant1

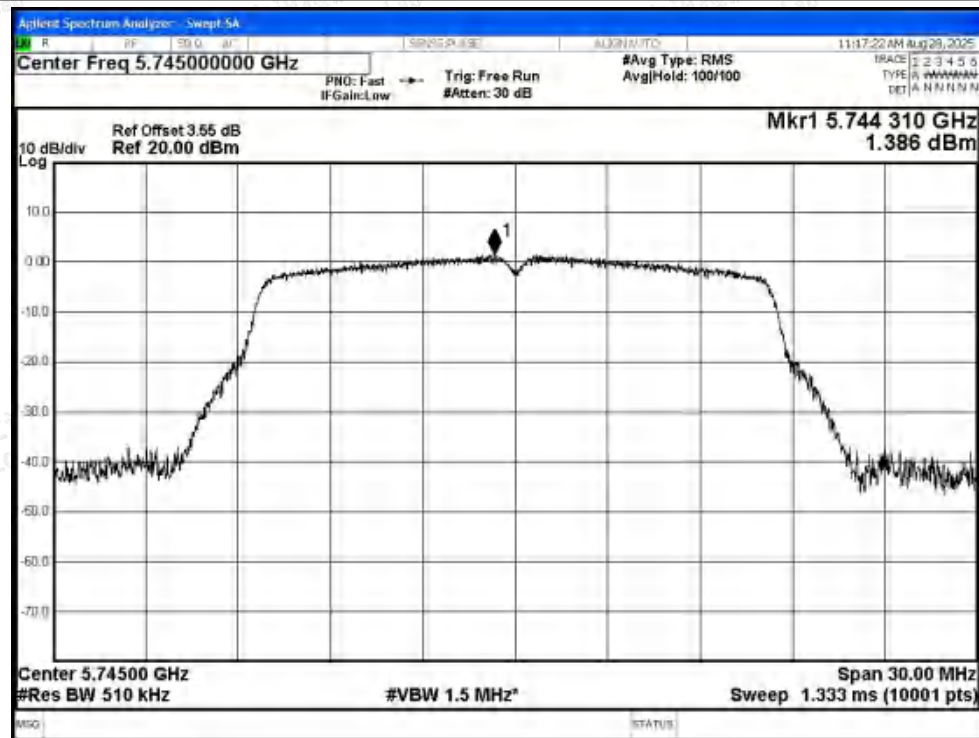


PSD NVNT a 5785MHz Ant1

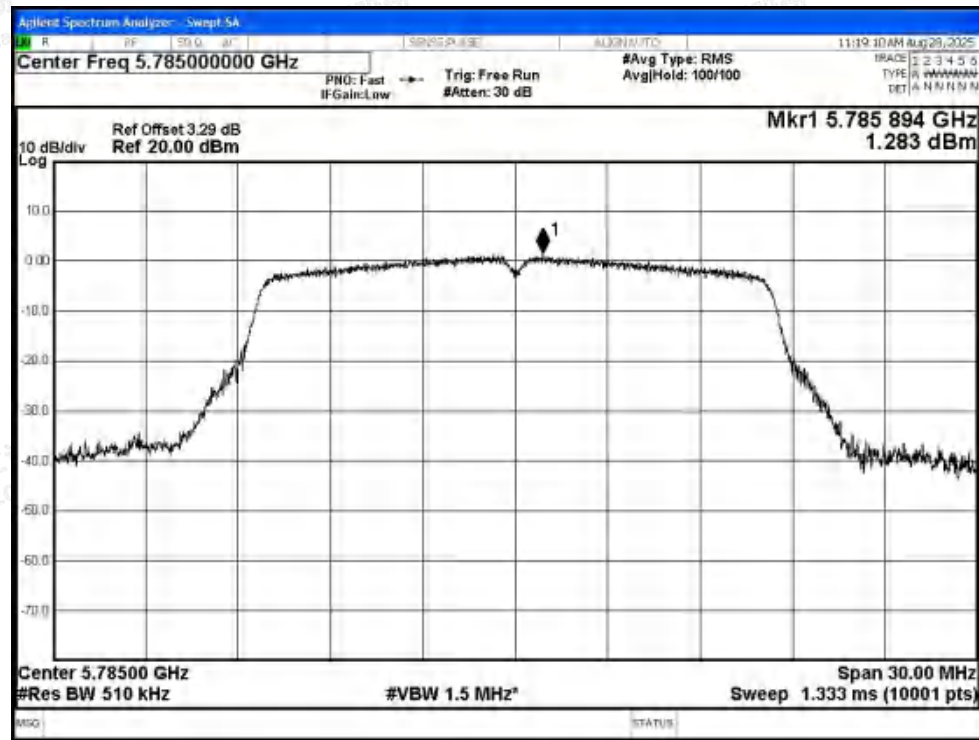




PSD NVNT a 5825MHz Ant1

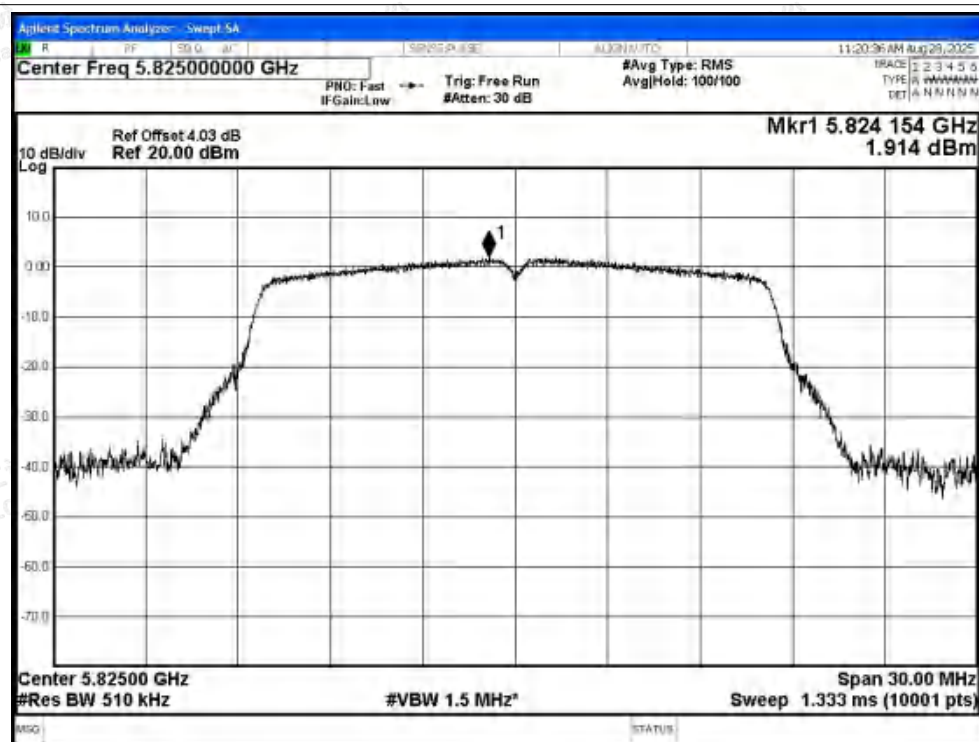


PSD NVNT n20 5745MHz Ant1

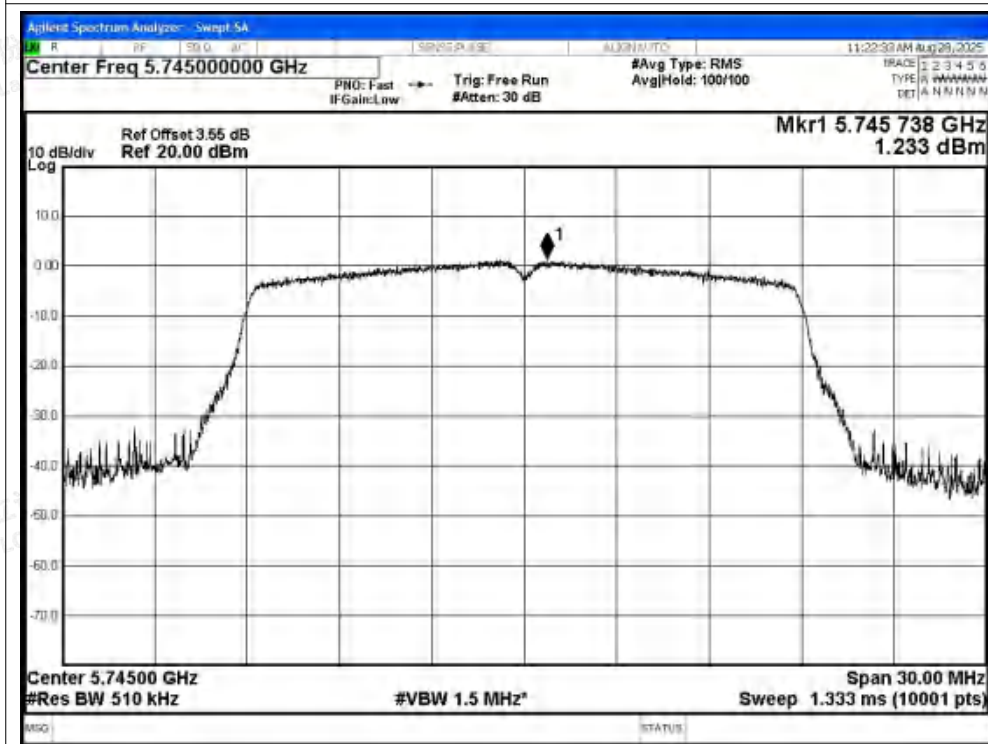




PSD NVNT n20 5785MHz Ant1

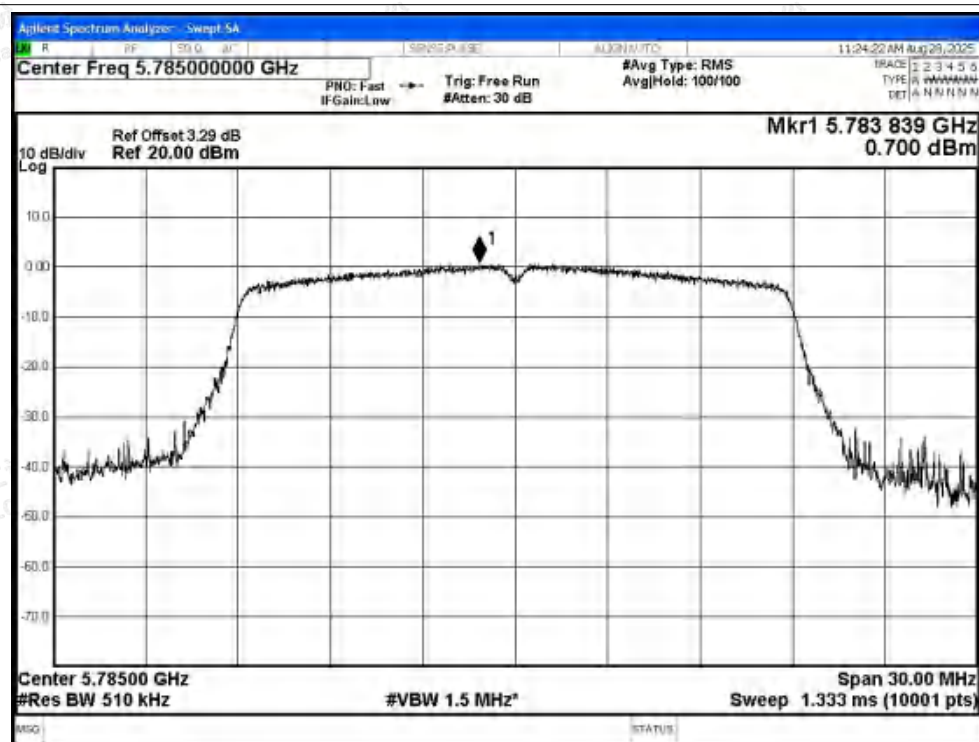


PSD NVNT n20 5825MHz Ant1

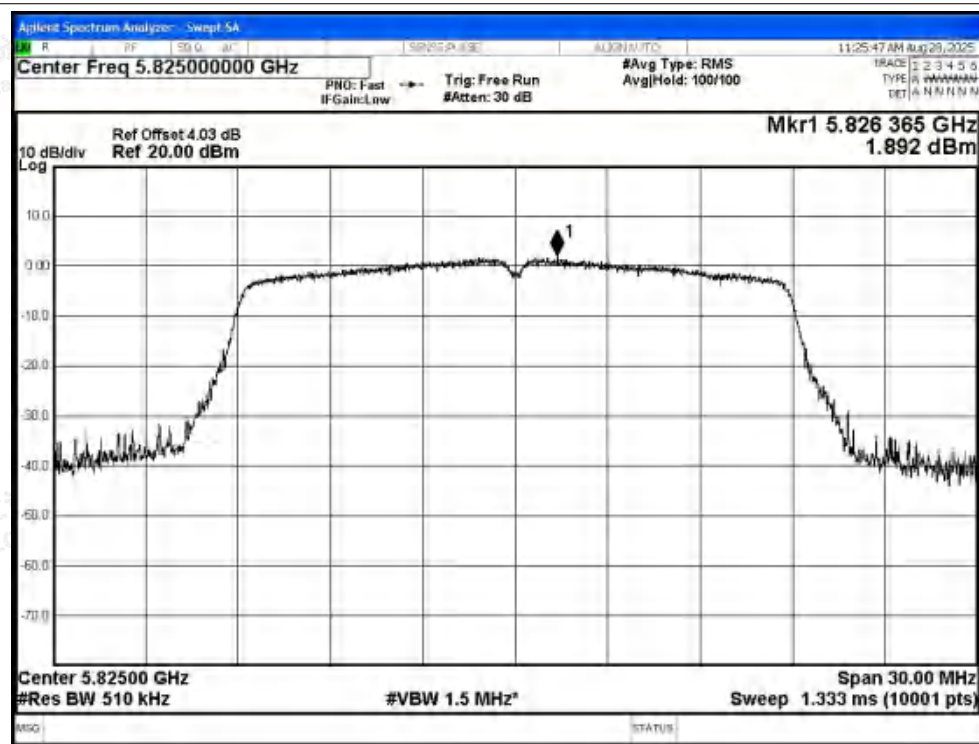





PSD NVNT n40 5755MHz Ant1

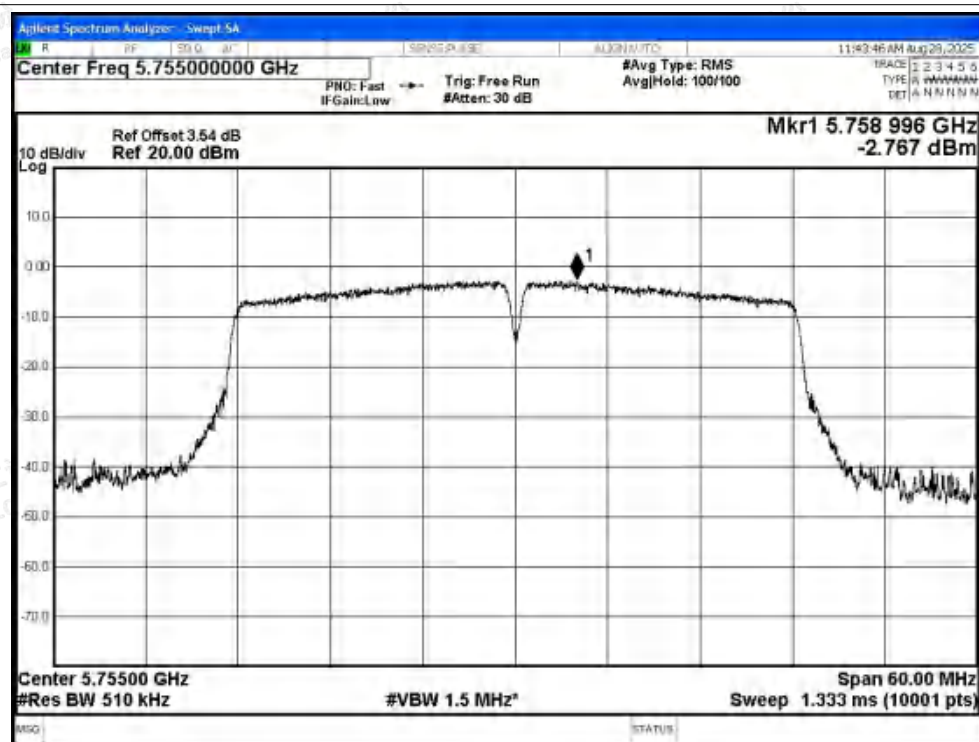


PSD NVNT n40 5795MHz Ant1

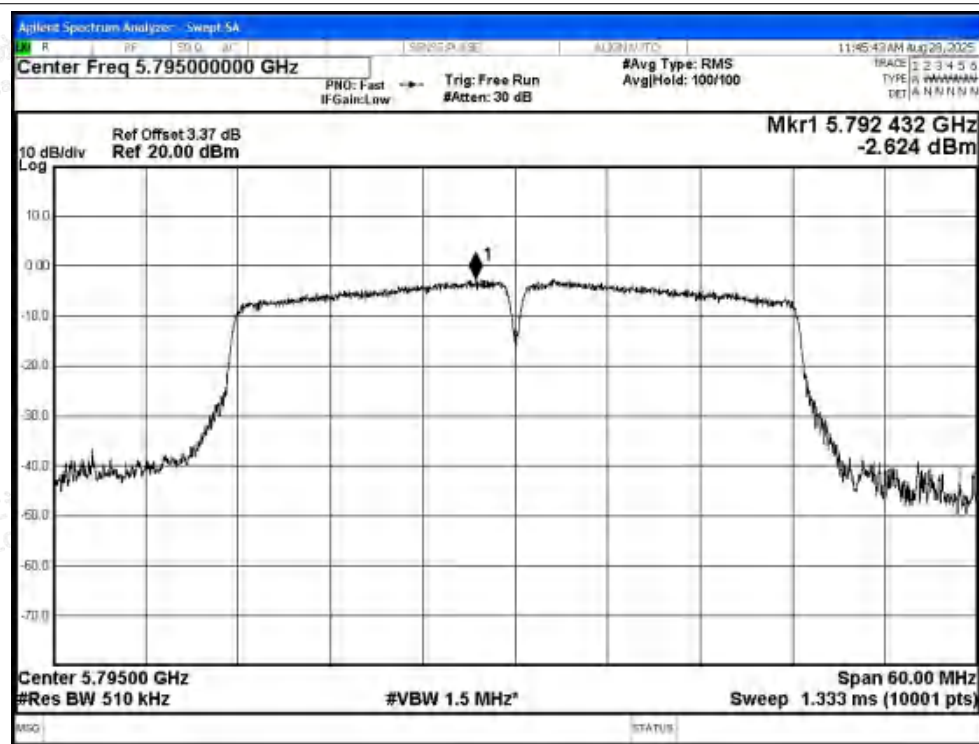




PSD NVNT ac20 5745MHz Ant1

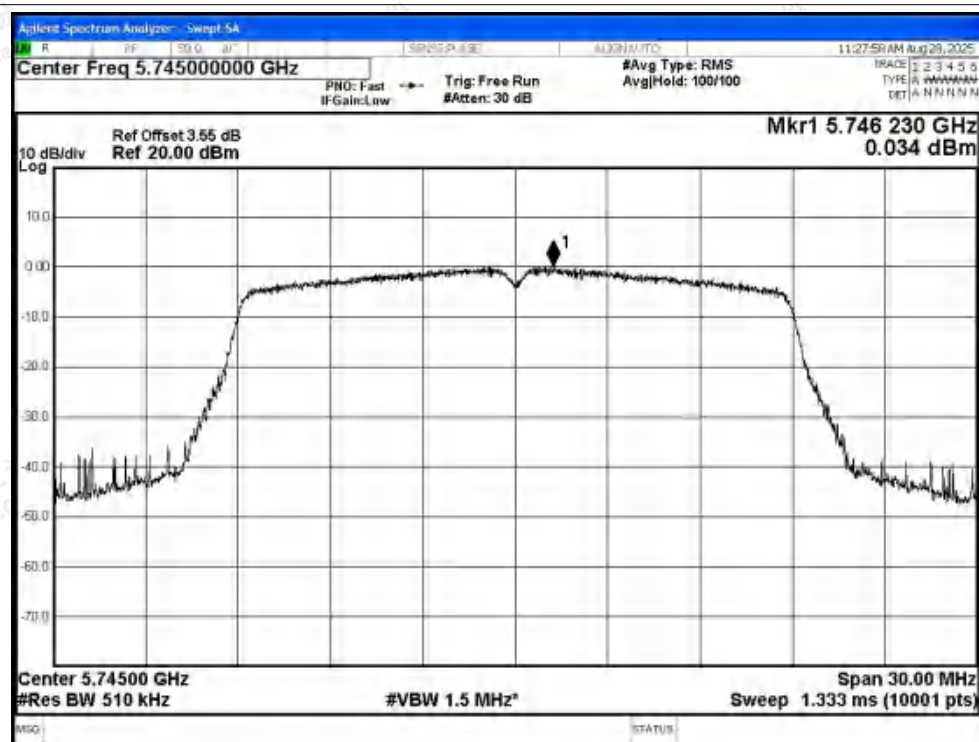


PSD NVNT ac20 5785MHz Ant1

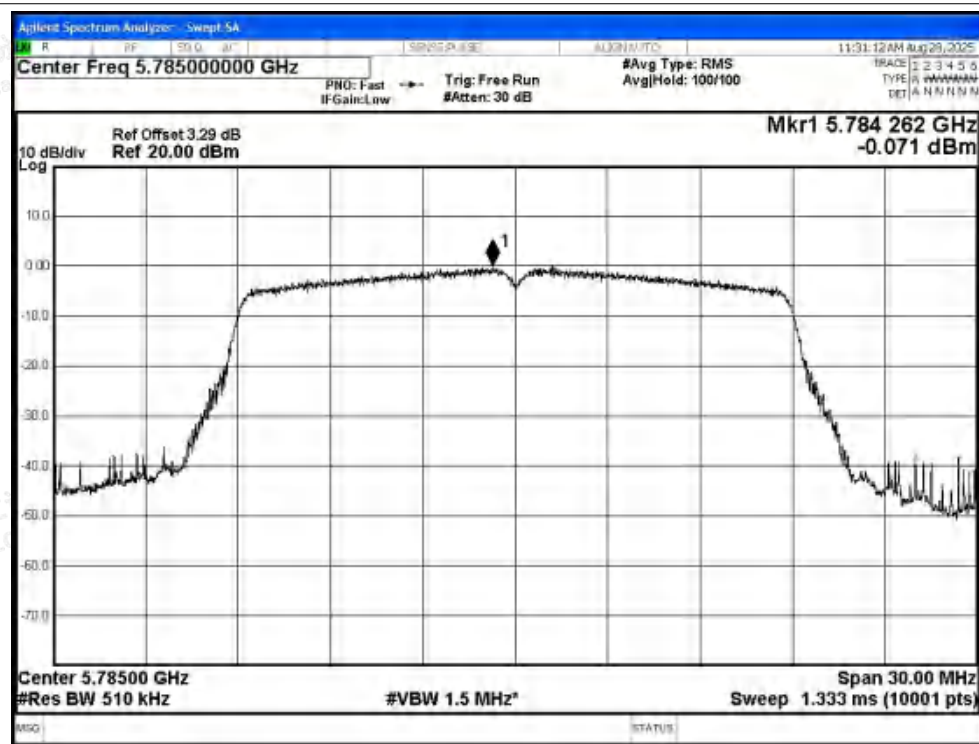





PSD NVNT ac20 5825MHz Ant1

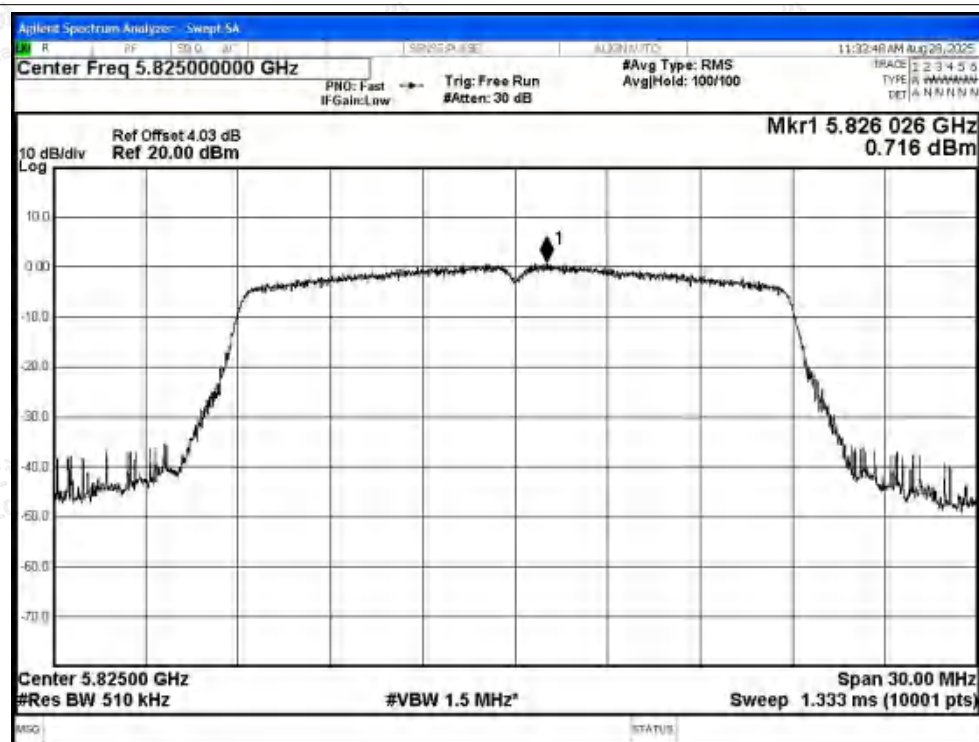


PSD NVNT ac40 5755MHz Ant1

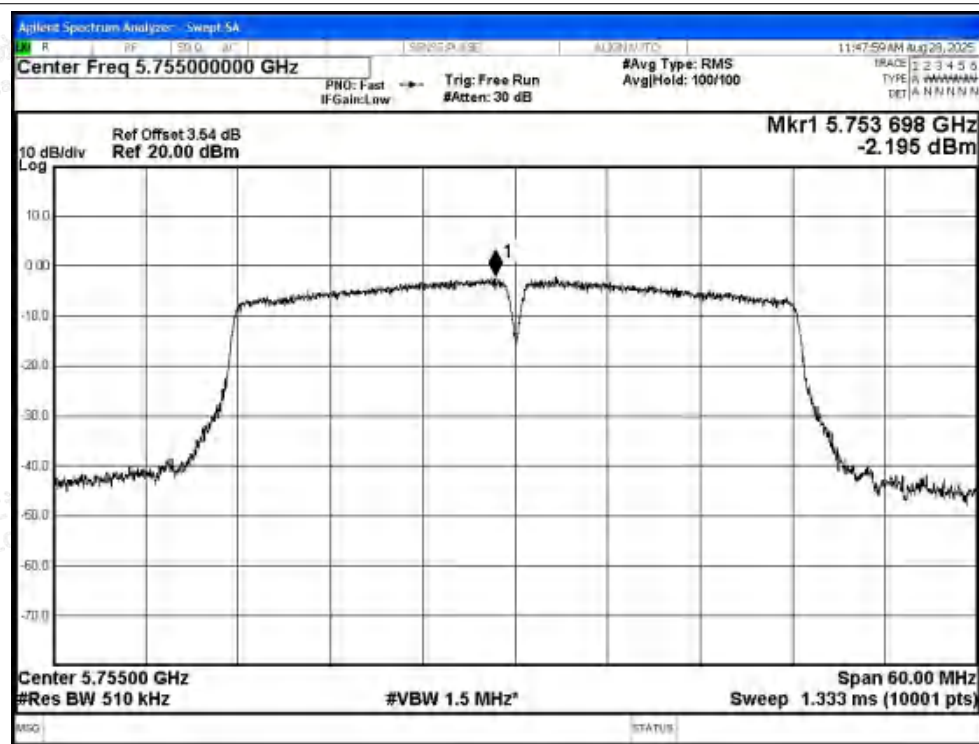

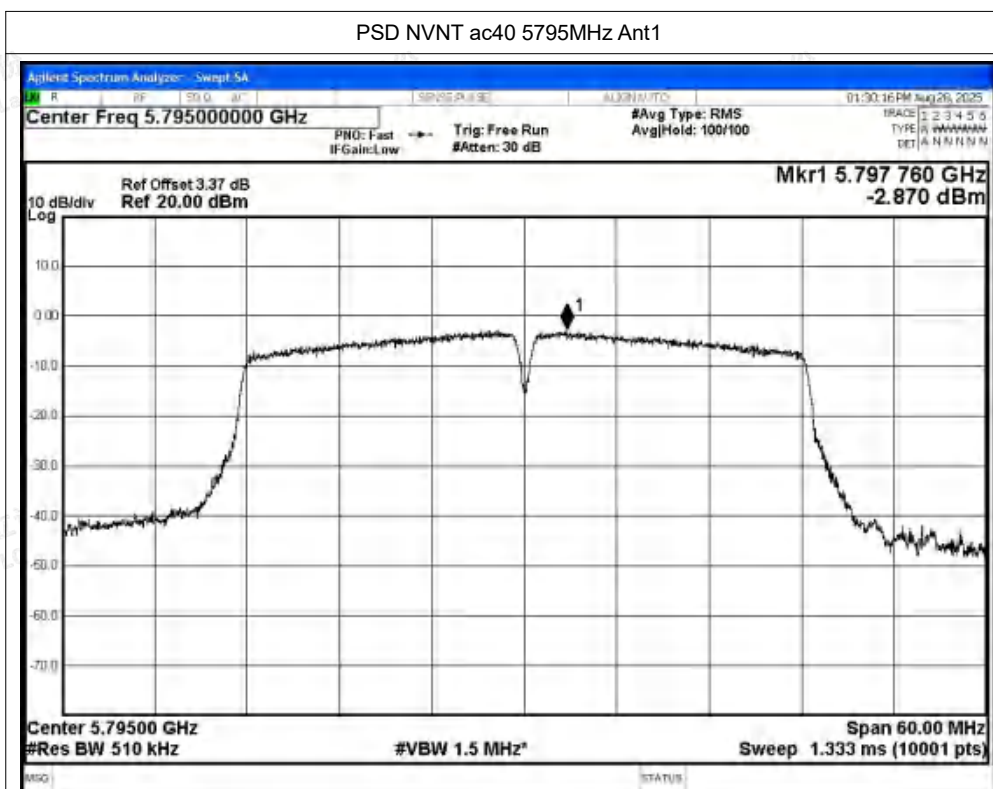

PSD NVNT ac80 5775MHz Ant1

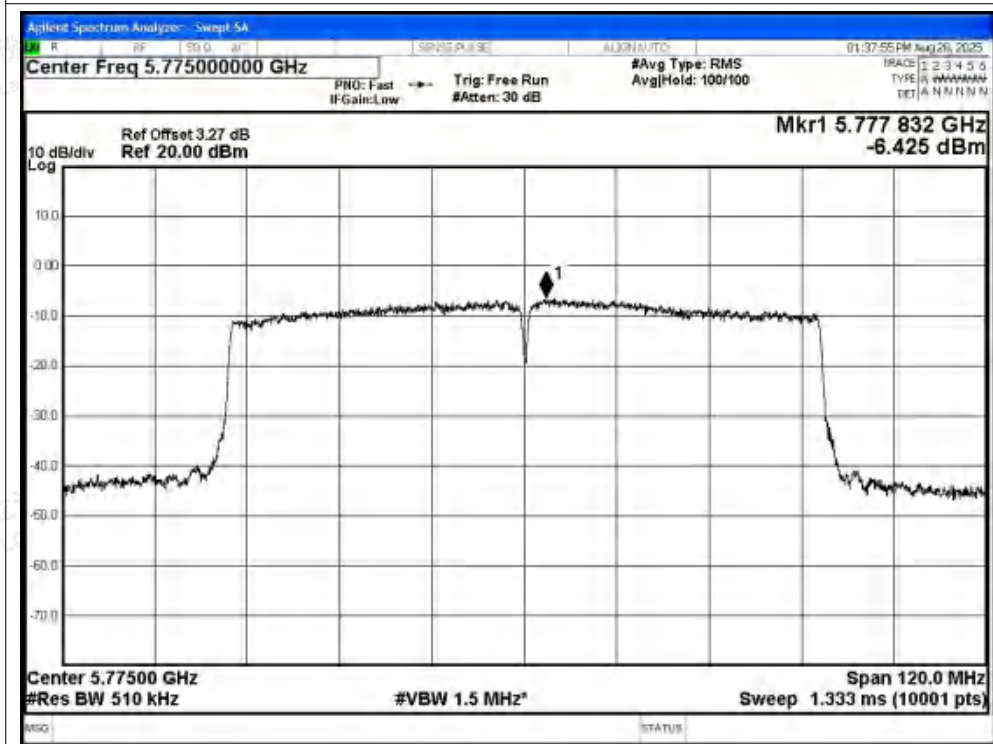


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5745MHz Ant1

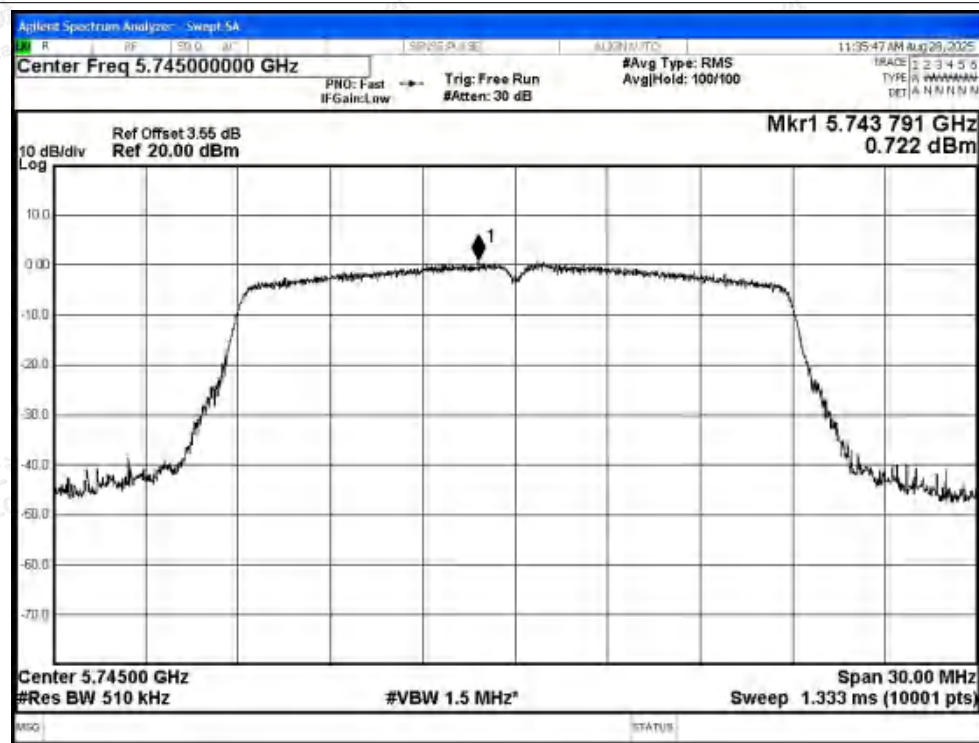

PSD NVNT ax20 5785MHz Ant1

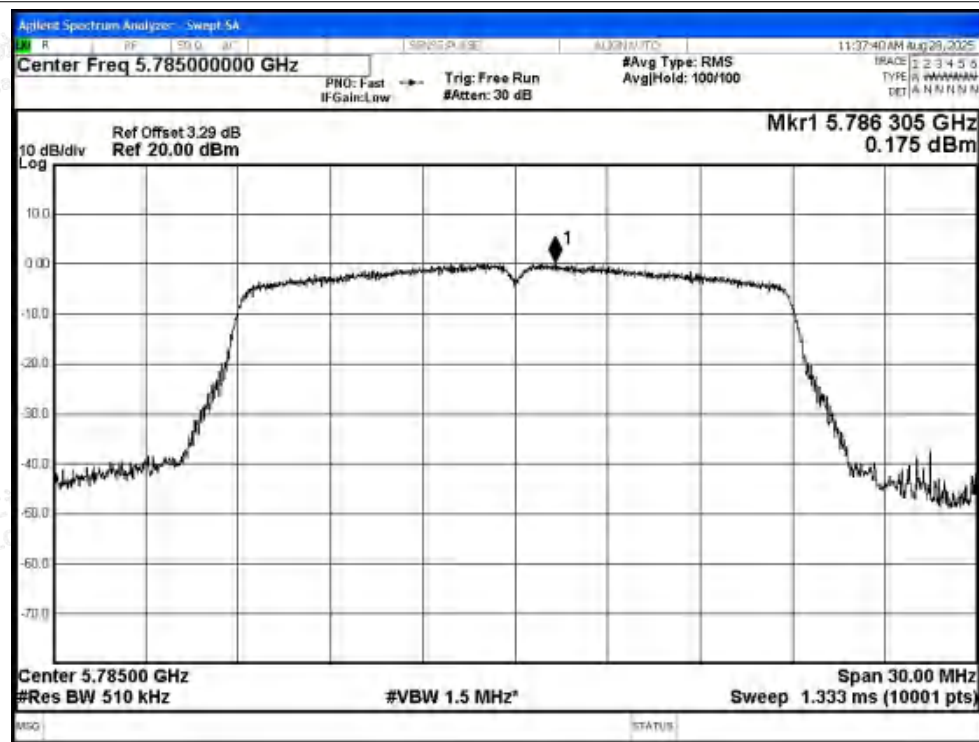

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5825MHz Ant1

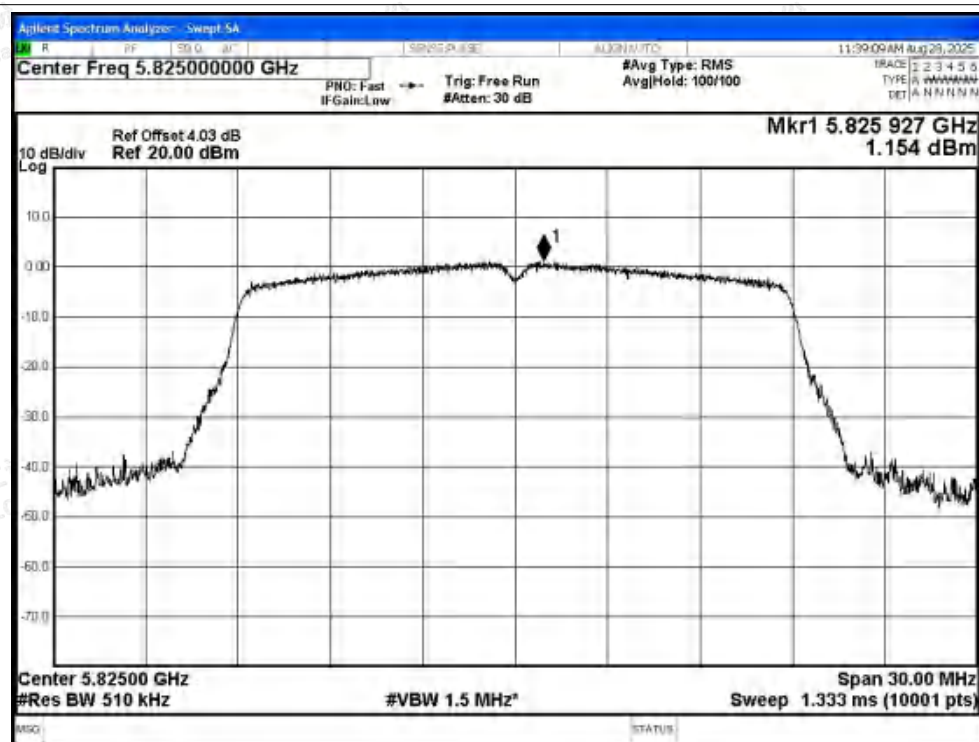


PSD NVNT ax40 5755MHz Ant1

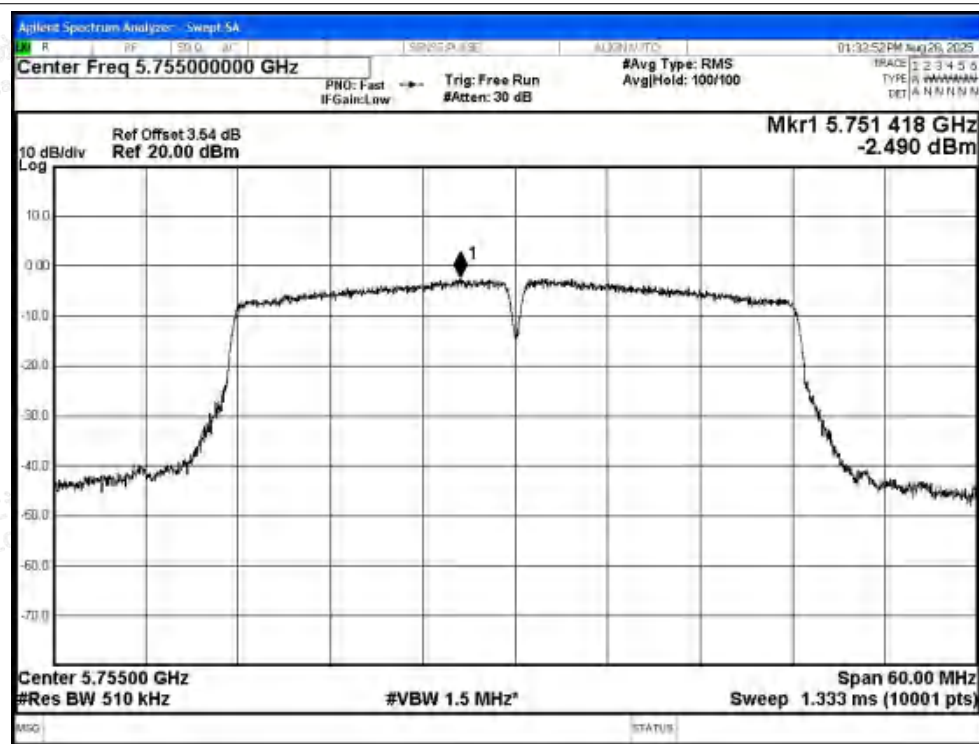




PSD NVNT ax40 5795MHz Ant1

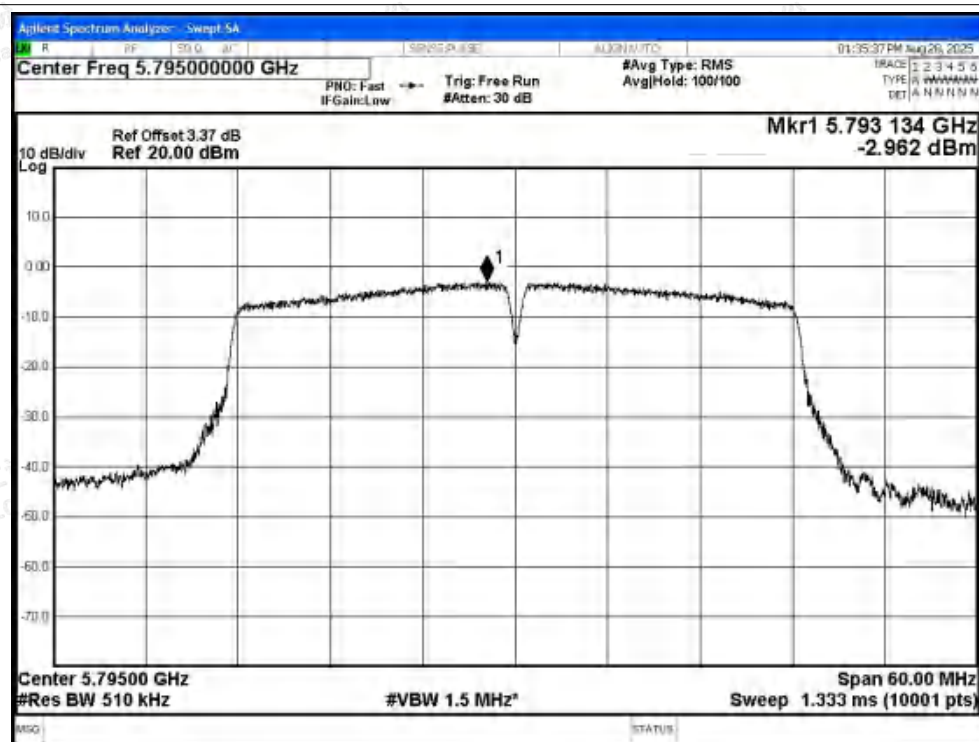

PSD NVNT ax80 5775MHz Ant1

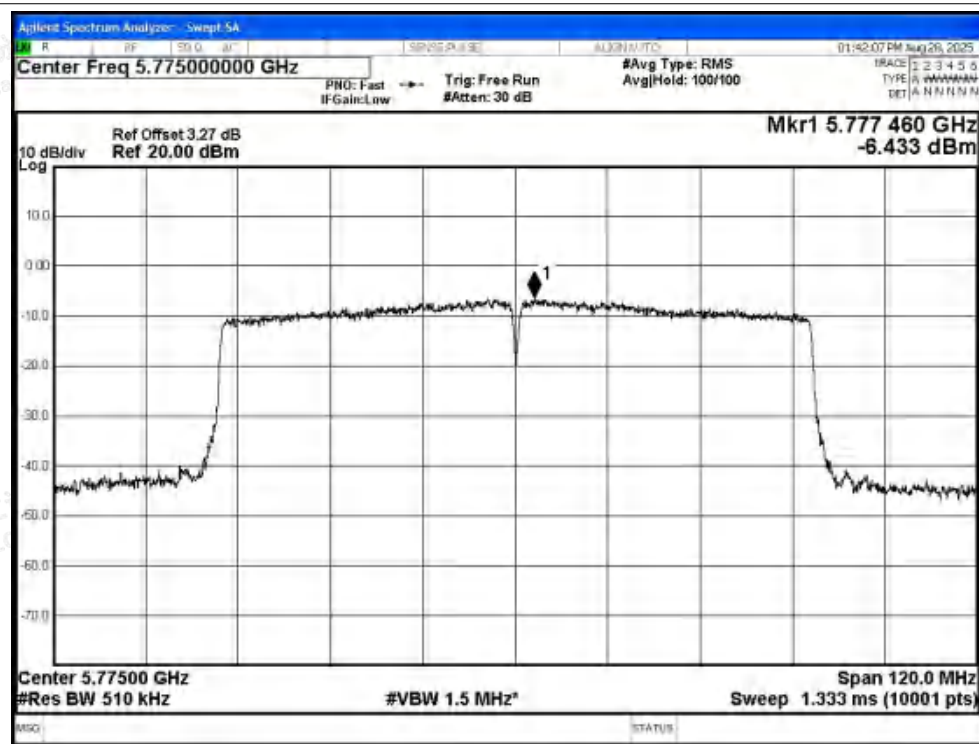


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

PSD NVNT a 5745MHz Ant2

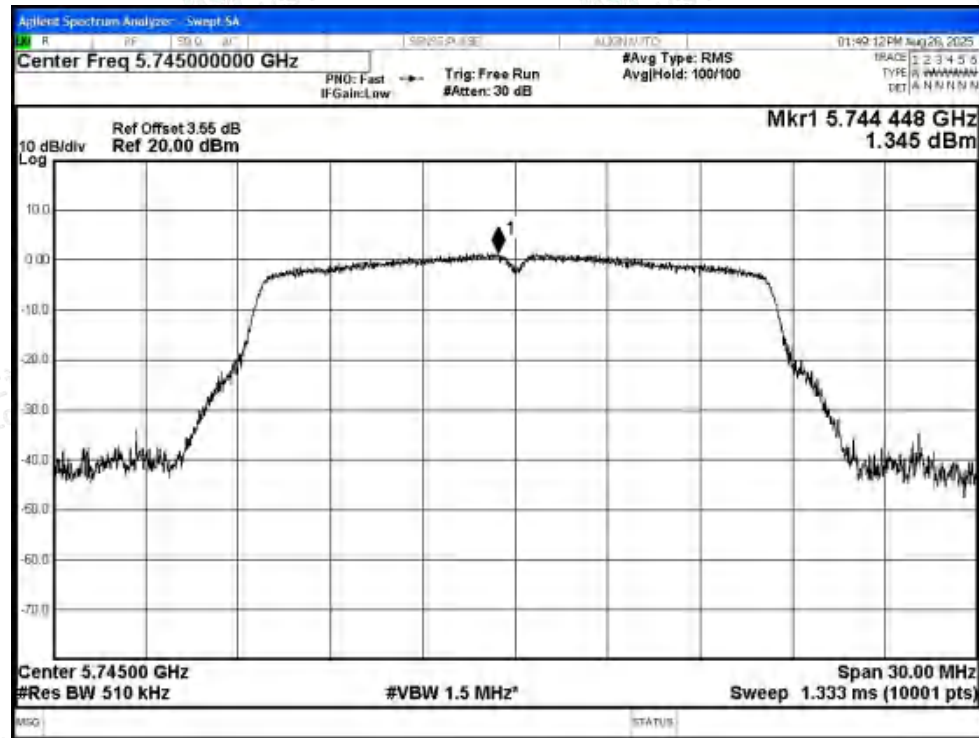

PSD NVNT a 5785MHz Ant2

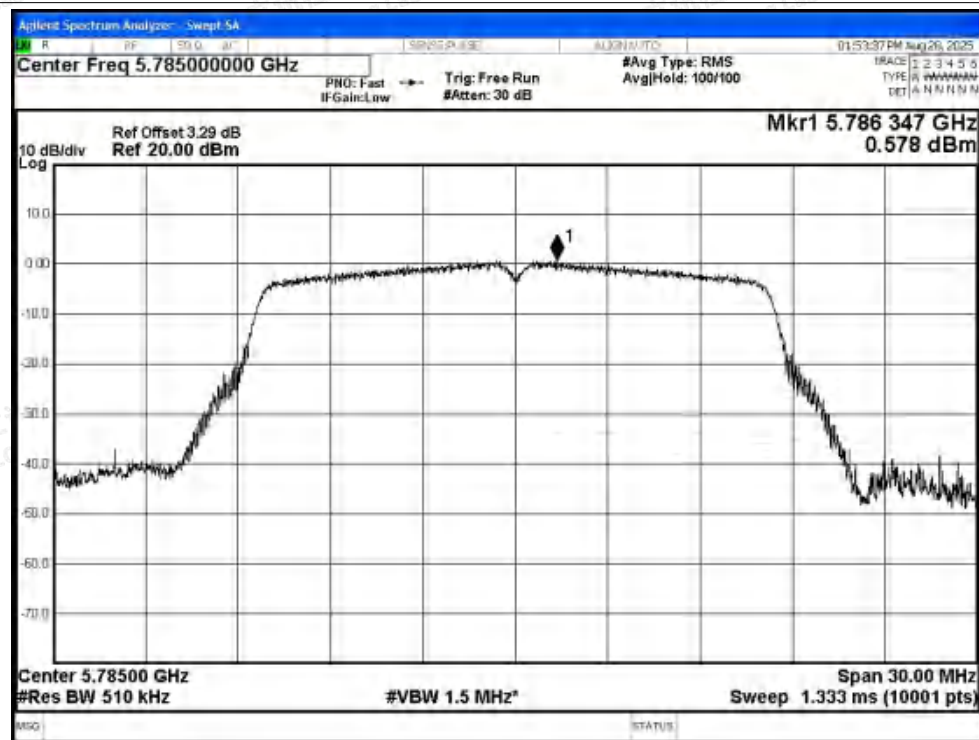

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT a 5825MHz Ant2

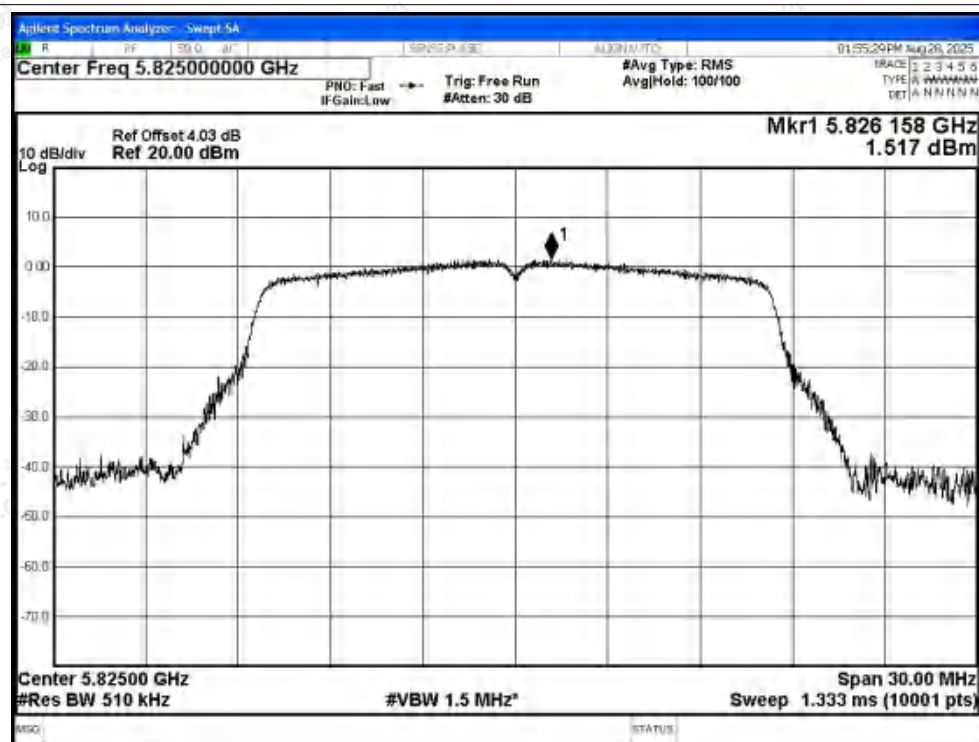

PSD NVNT n20 5745MHz Ant2

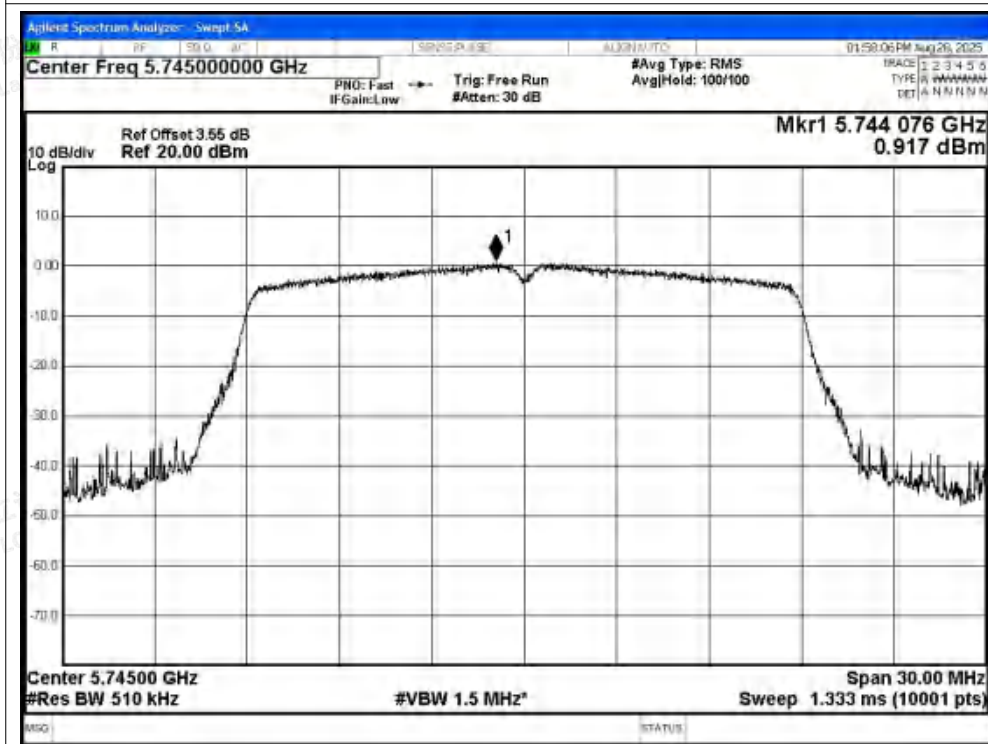

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT n20 5785MHz Ant2

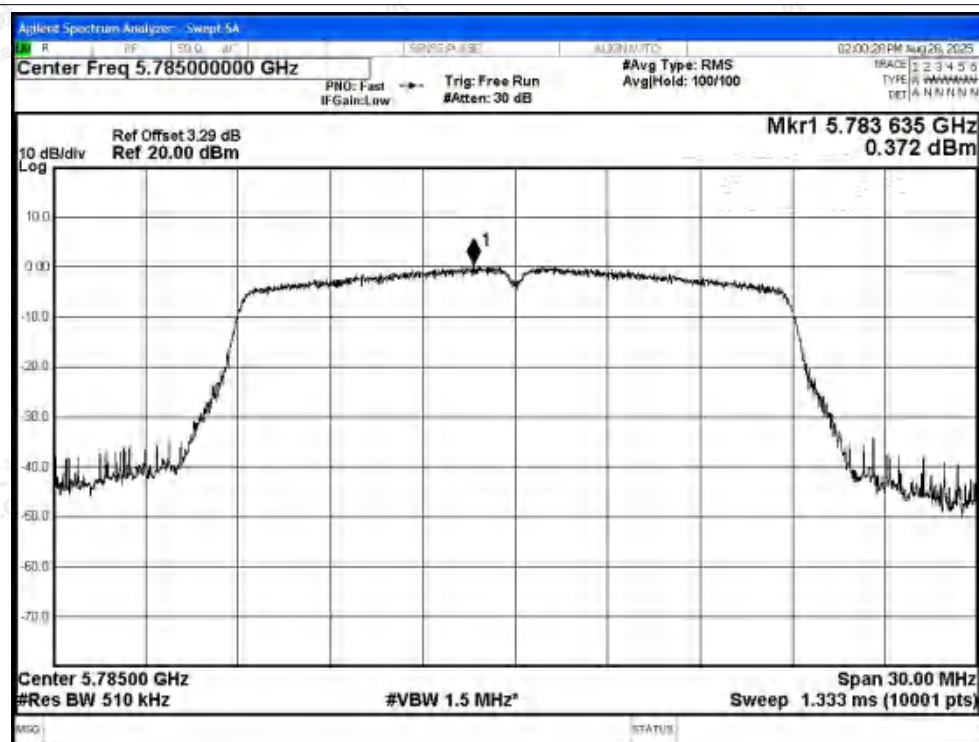

PSD NVNT n20 5825MHz Ant2

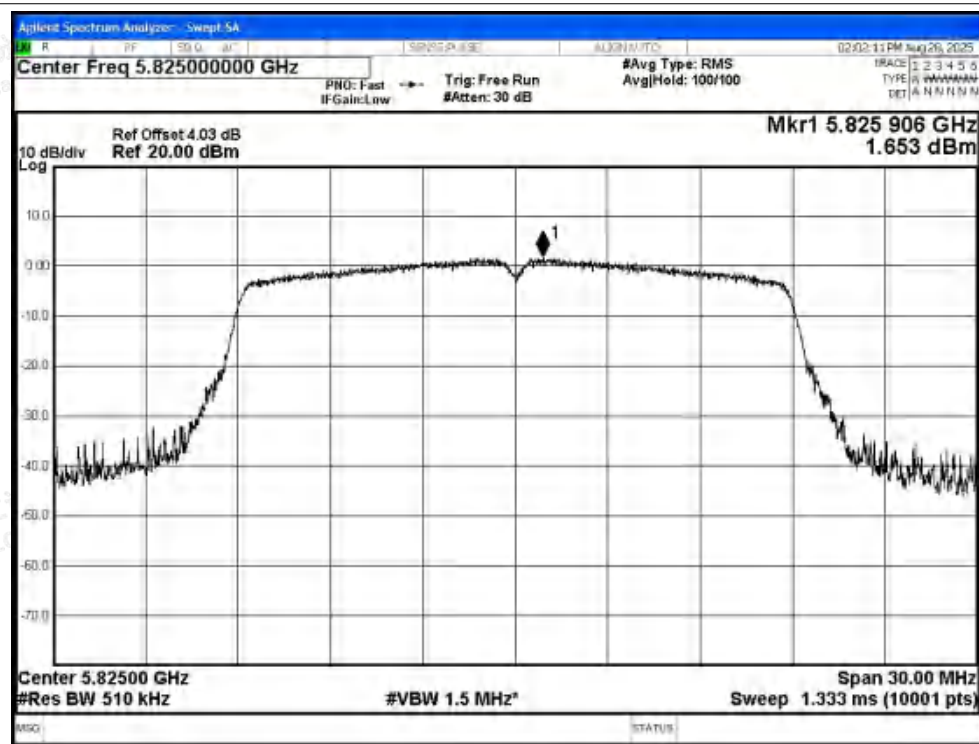


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

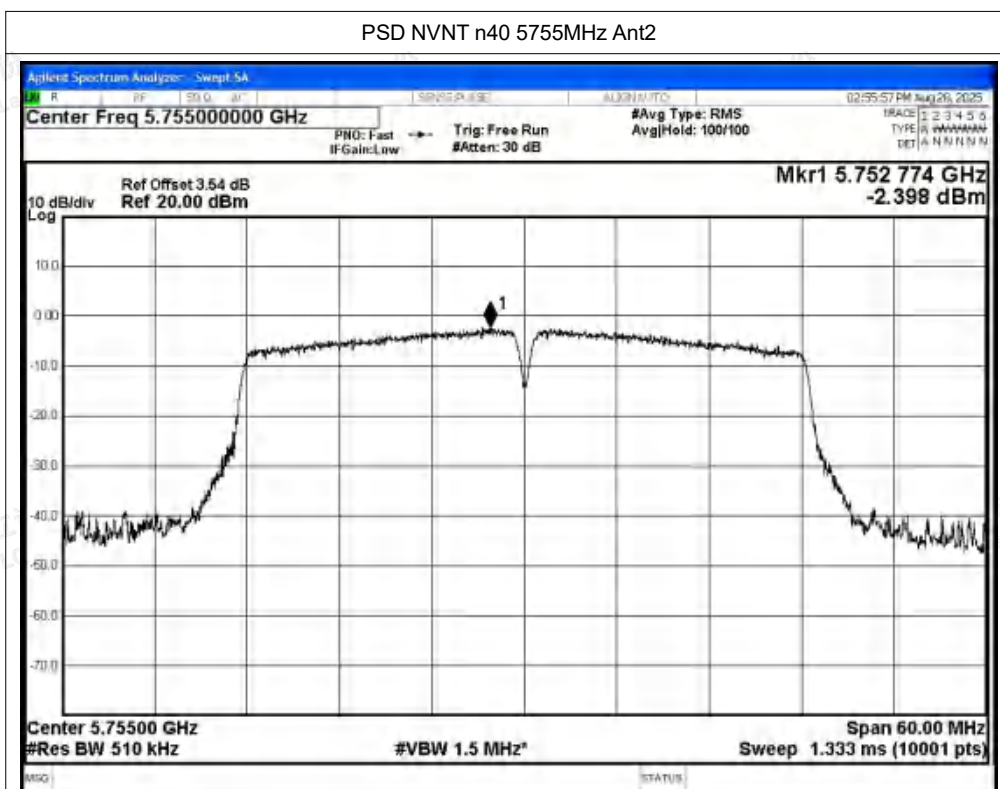

PSD NVNT n40 5795MHz Ant2

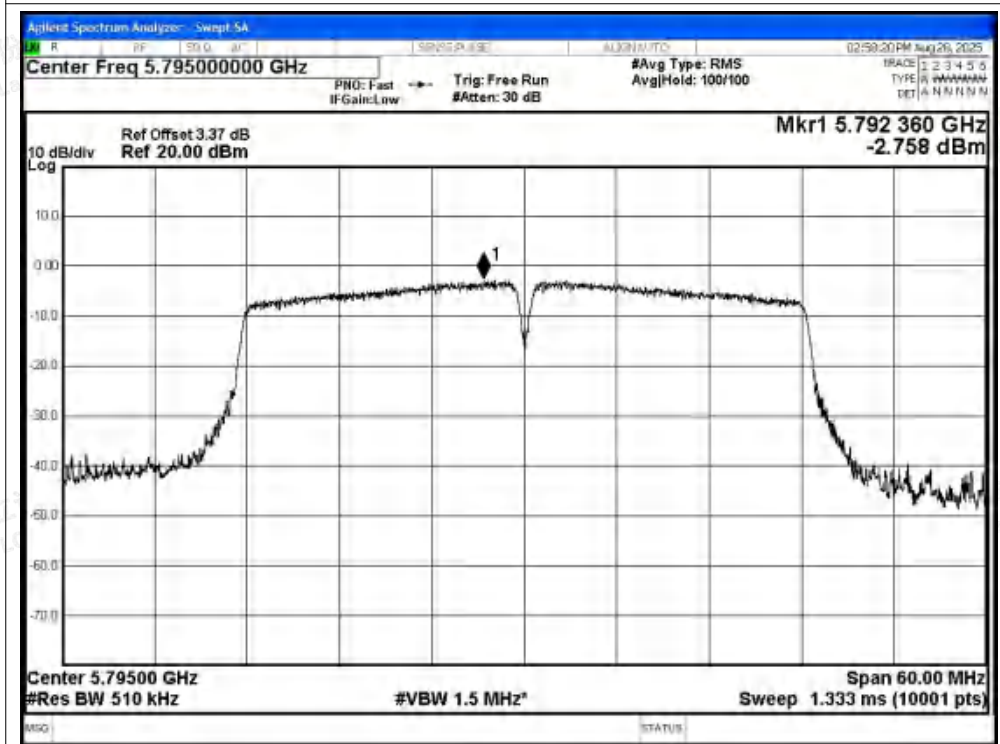

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5745MHz Ant2

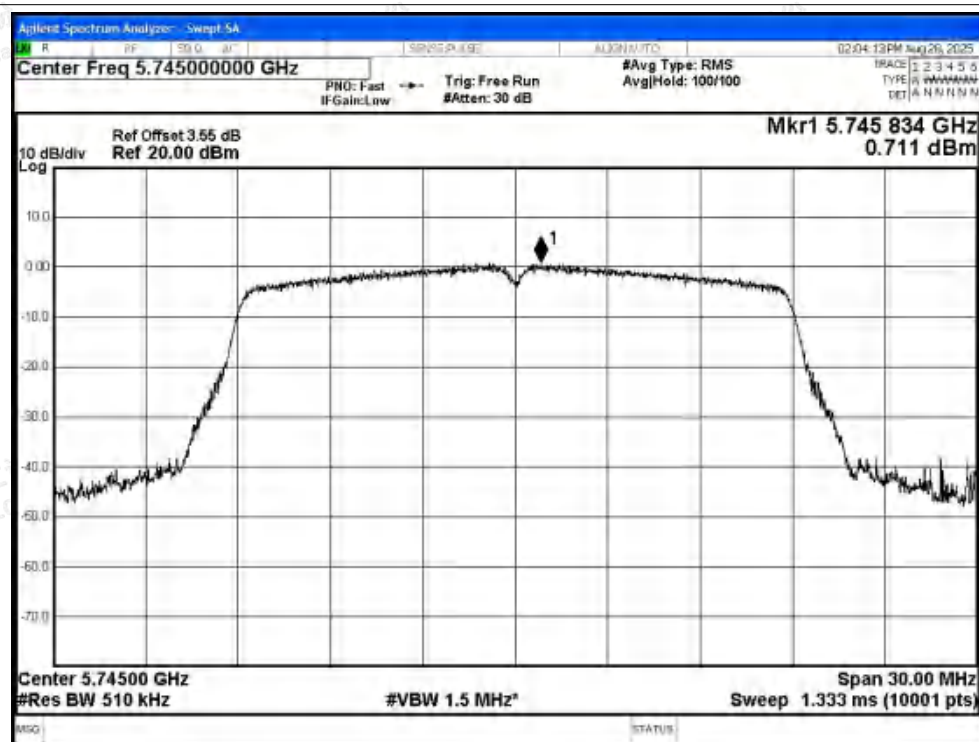

PSD NVNT ac20 5785MHz Ant2

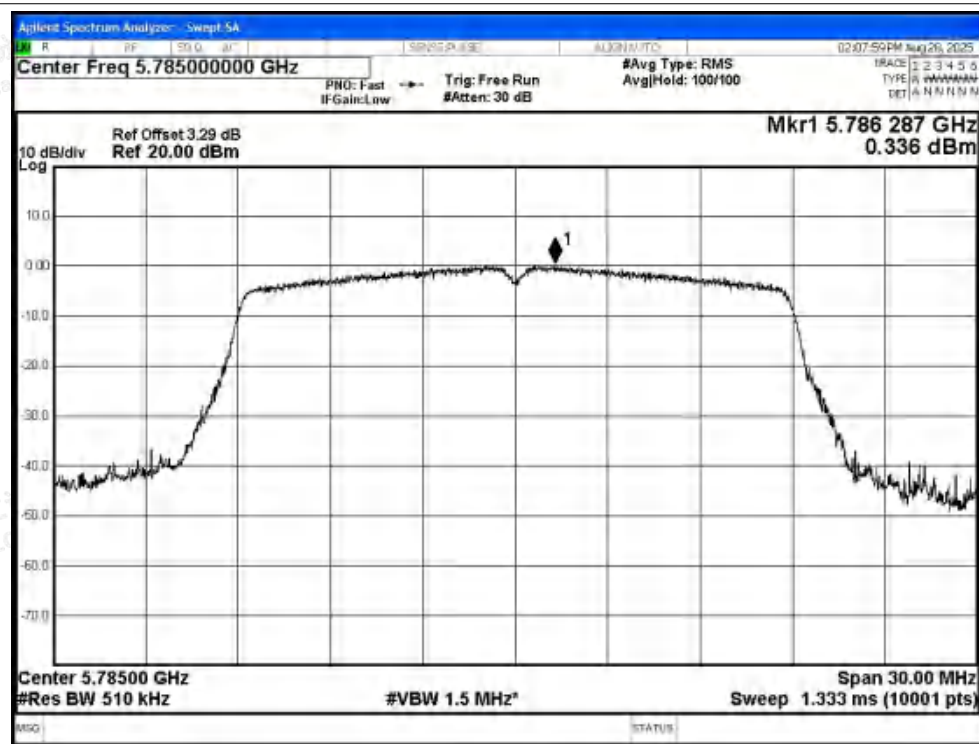

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5825MHz Ant2

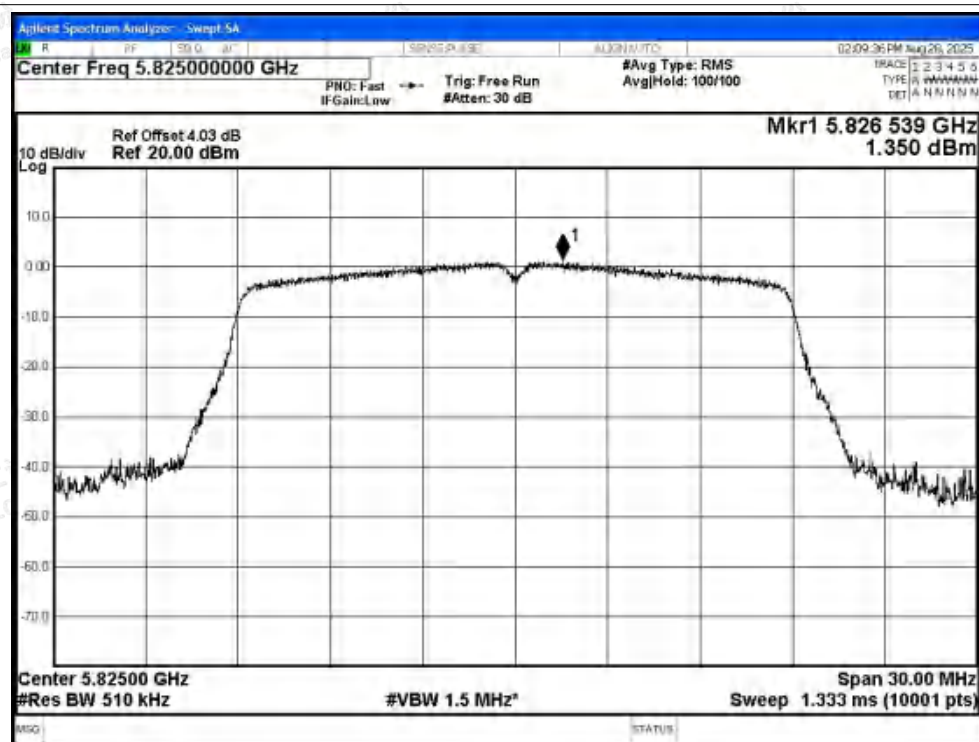

PSD NVNT ac40 5755MHz Ant2

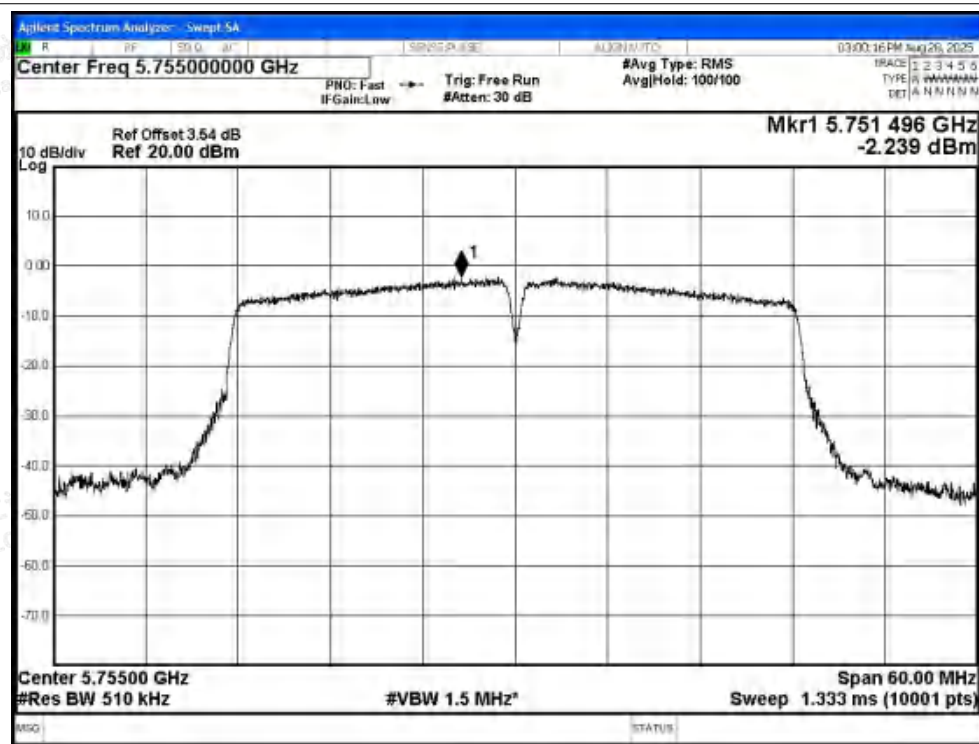

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5795MHz Ant2

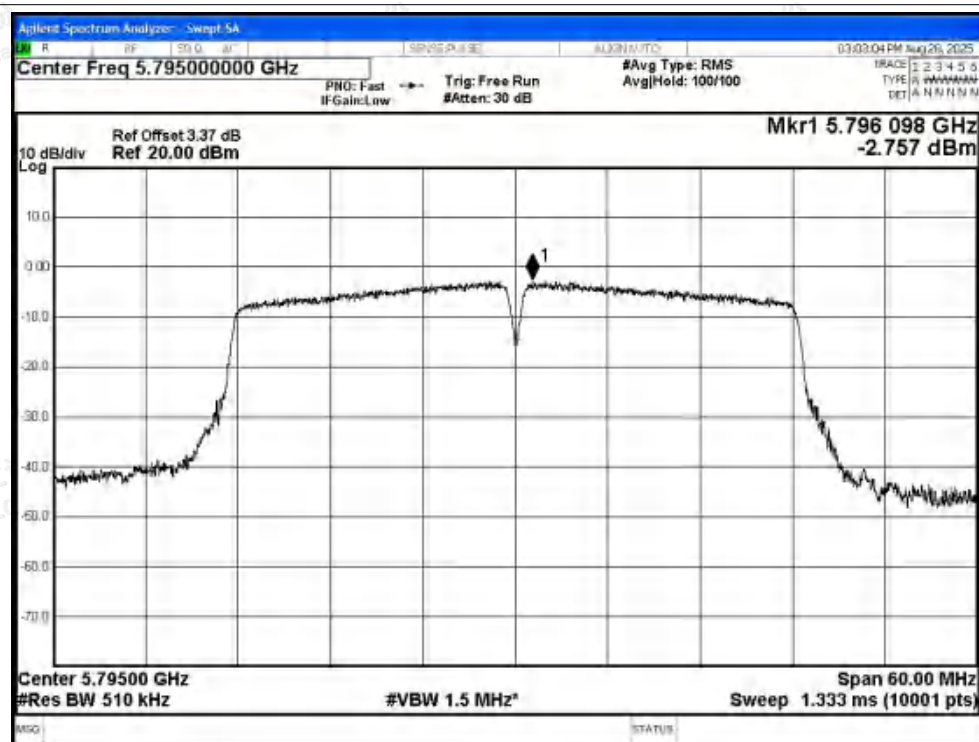

PSD NVNT ac80 5775MHz Ant2

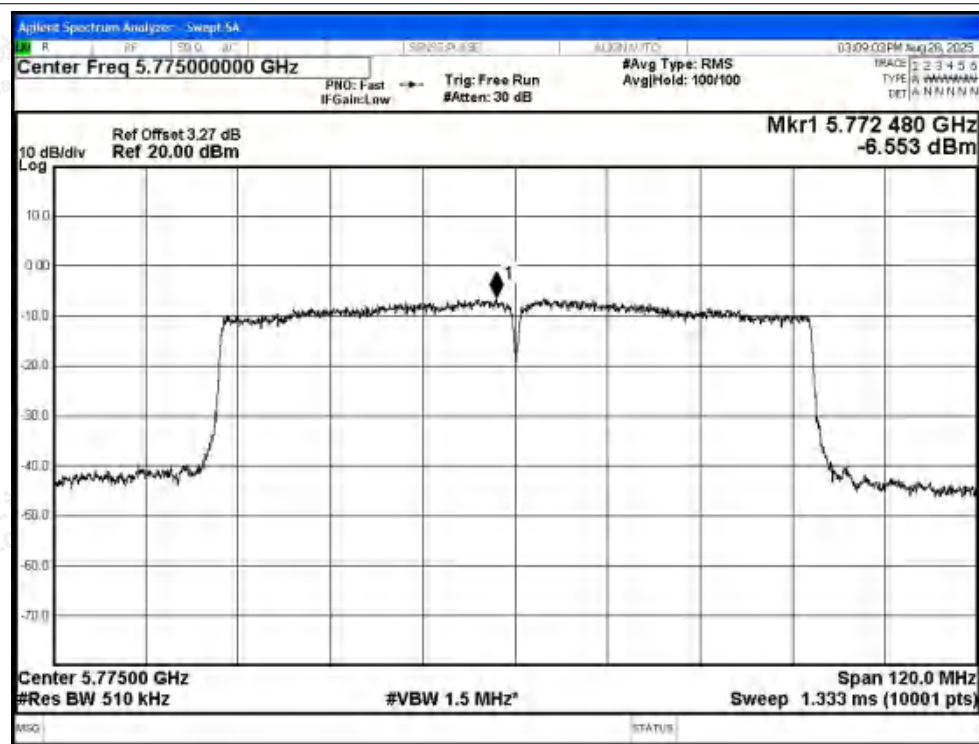

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5745MHz Ant2

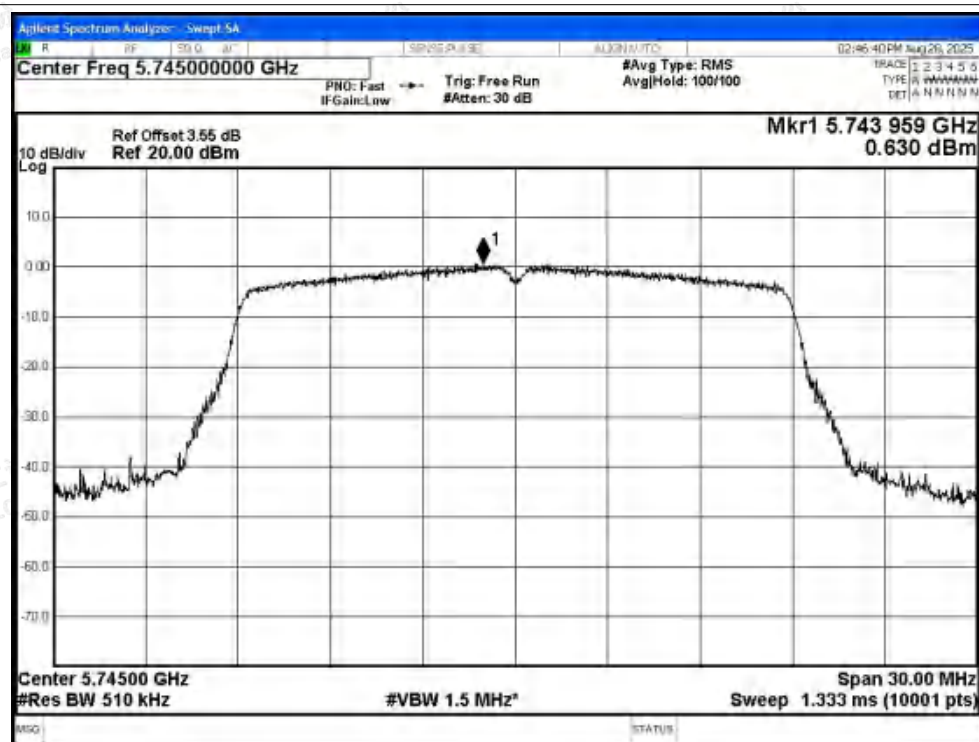


PSD NVNT ax20 5785MHz Ant2

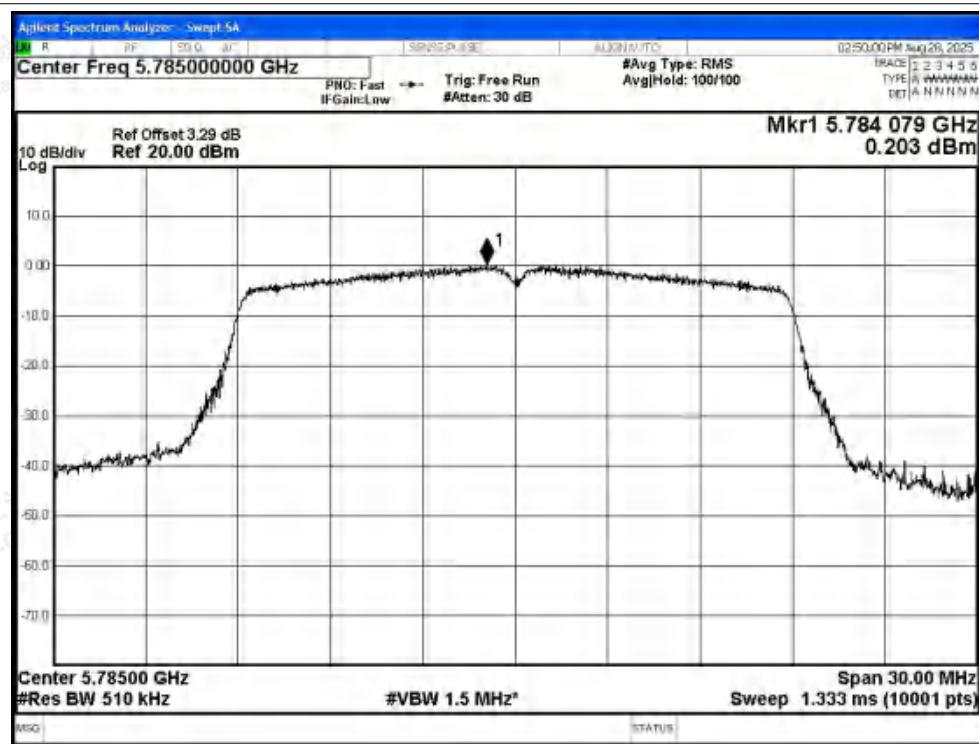




PSD NVNT ax20 5825MHz Ant2

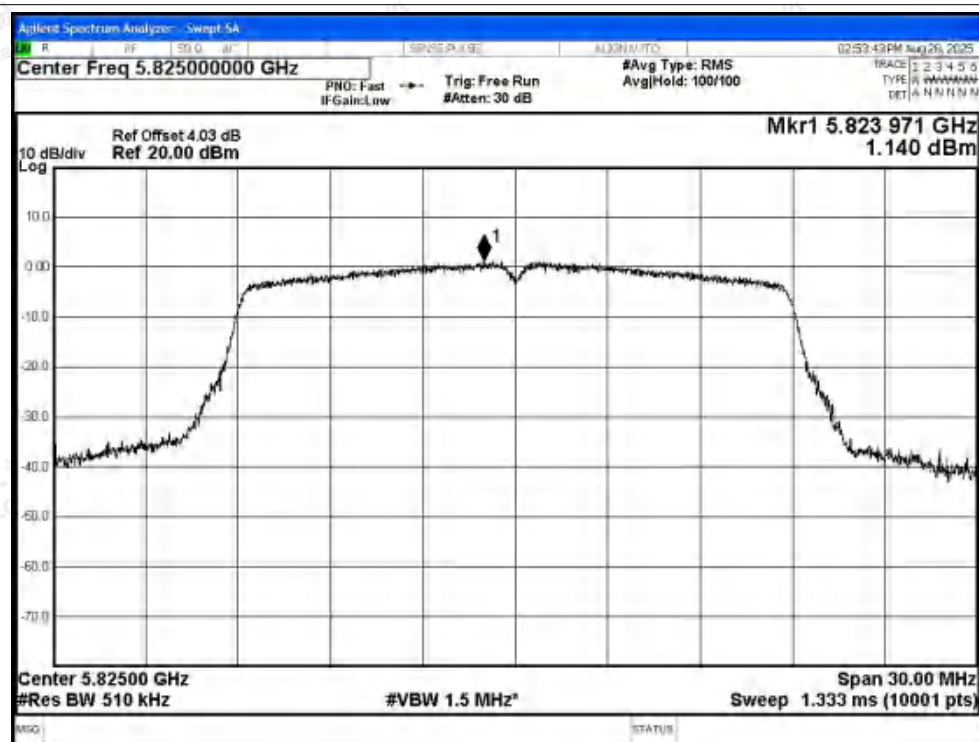


PSD NVNT ax40 5755MHz Ant2

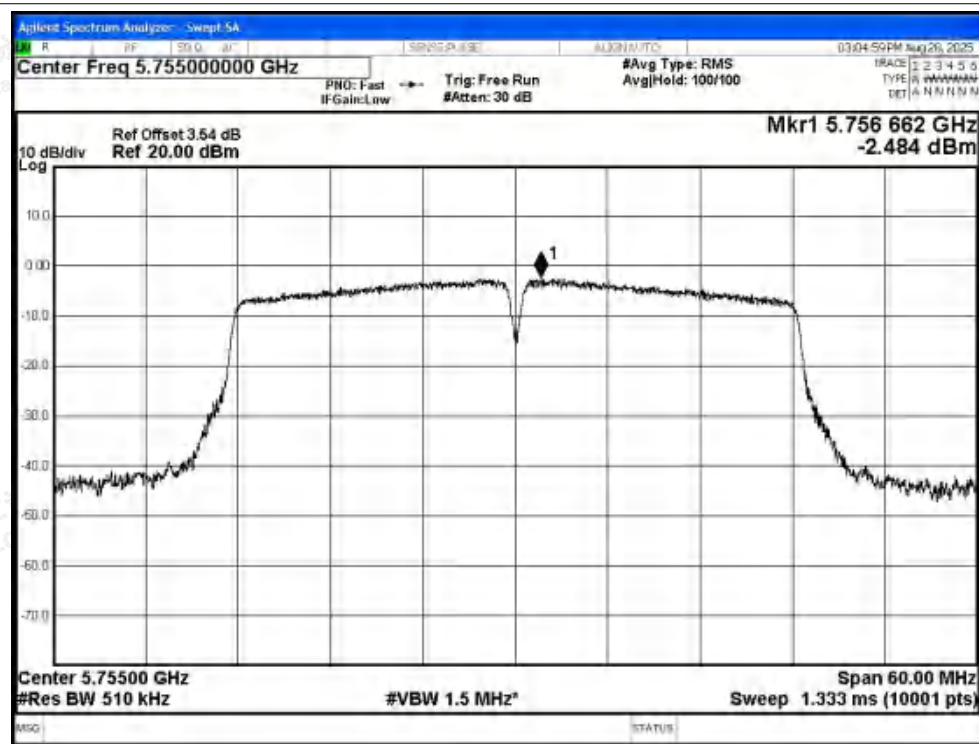



PSD NVNT ax40 5795MHz Ant2

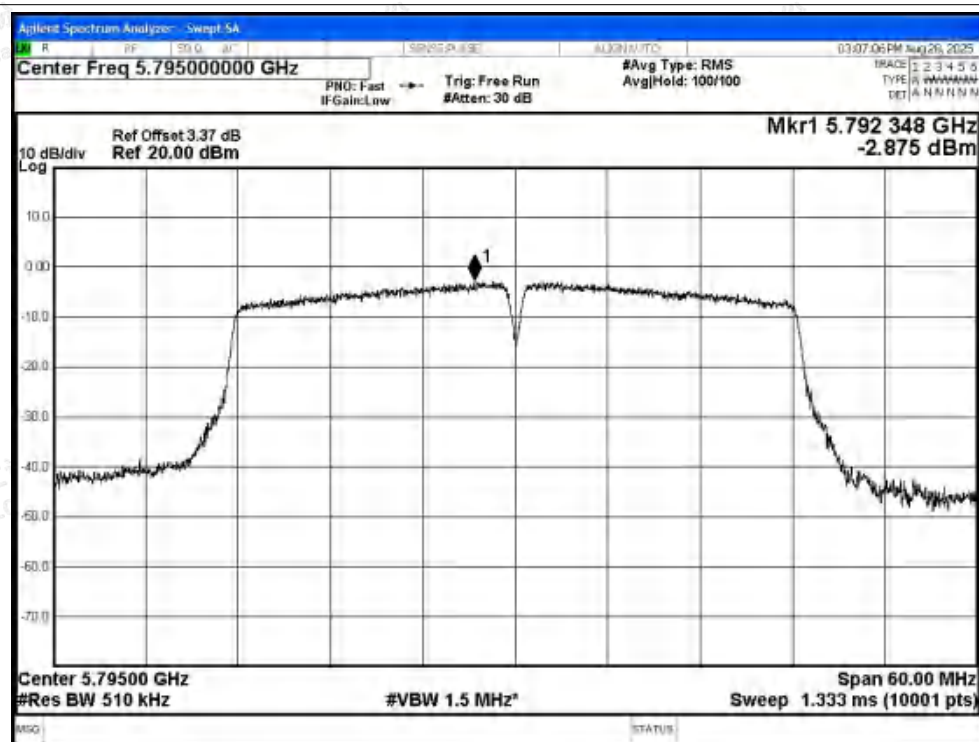

PSD NVNT ax80 5775MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant1	5650	-47.1	5.02	-	-42.08	Peak	-27	Pass
NVNT	a	5745	Ant1	5650	-55.58	5.02	0.1	-50.46	Average	-27	Pass
NVNT	a	5745	Ant1	5700	-45.58	5.02	-	-40.56	Peak	10	Pass
NVNT	a	5745	Ant1	5700	-54.25	5.02	0.1	-49.13	Average	10	Pass
NVNT	a	5745	Ant1	5720	-33.84	5.02	-	-28.82	Peak	15.6	Pass
NVNT	a	5745	Ant1	5720	-46.26	5.02	0.1	-41.14	Average	15.6	Pass
NVNT	a	5745	Ant1	5725	-27.74	5.02	-	-22.72	Peak	27	Pass
NVNT	a	5745	Ant1	5725	-43.81	5.02	0.1	-38.69	Average	27	Pass
NVNT	a	5825	Ant1	5850	-27.92	5.02	-	-22.9	Peak	27	Pass
NVNT	a	5825	Ant1	5850	-45.22	5.02	0.1	-40.1	Average	27	Pass
NVNT	a	5825	Ant1	5855	-36.07	5.02	-	-31.05	Peak	15.6	Pass
NVNT	a	5825	Ant1	5855	-49.54	5.02	0.1	-44.42	Average	15.6	Pass
NVNT	a	5825	Ant1	5875	-45.32	5.02	-	-40.3	Peak	10	Pass
NVNT	a	5825	Ant1	5875	-53.66	5.02	0.1	-48.54	Average	10	Pass
NVNT	a	5825	Ant1	5925	-46.55	5.02	-	-41.53	Peak	-27	Pass
NVNT	a	5825	Ant1	5925	-55.19	5.02	0.1	-50.07	Average	-27	Pass
NVNT	n20	5745	Ant1	5650	-49.01	5.02	-	-43.99	Peak	-27	Pass
NVNT	n20	5745	Ant1	5650	-56.72	5.02	0.11	-51.59	Average	-27	Pass
NVNT	n20	5745	Ant1	5700	-42.37	5.02	-	-37.35	Peak	10	Pass
NVNT	n20	5745	Ant1	5700	-53.64	5.02	0.11	-48.51	Average	10	Pass
NVNT	n20	5745	Ant1	5720	-31.89	5.02	-	-26.87	Peak	15.6	Pass
NVNT	n20	5745	Ant1	5720	-47.81	5.02	0.11	-42.68	Average	15.6	Pass
NVNT	n20	5745	Ant1	5725	-26.94	5.02	-	-21.92	Peak	27	Pass
NVNT	n20	5745	Ant1	5725	-42.22	5.02	0.11	-37.09	Average	27	Pass
NVNT	n20	5825	Ant1	5850	-30.3	5.02	-	-25.28	Peak	27	Pass
NVNT	n20	5825	Ant1	5850	-45.11	5.02	0.11	-39.98	Average	27	Pass
NVNT	n20	5825	Ant1	5855	-36.22	5.02	-	-31.2	Peak	15.6	Pass
NVNT	n20	5825	Ant1	5855	-49.22	5.02	0.11	-44.09	Average	15.6	Pass
NVNT	n20	5825	Ant1	5875	-45.8	5.02	-	-40.78	Peak	10	Pass
NVNT	n20	5825	Ant1	5875	-53.3	5.02	0.11	-48.17	Average	10	Pass
NVNT	n20	5825	Ant1	5925	-47.07	5.02	-	-42.05	Peak	-27	Pass
NVNT	n20	5825	Ant1	5925	-55.46	5.02	0.11	-50.33	Average	-27	Pass
NVNT	n40	5755	Ant1	5650	-45.61	5.02	-	-40.59	Peak	-27	Pass
NVNT	n40	5755	Ant1	5650	-56.08	5.02	0.23	-50.83	Average	-27	Pass
NVNT	n40	5755	Ant1	5700	-42.84	5.02	-	-37.82	Peak	10	Pass
NVNT	n40	5755	Ant1	5700	-51.71	5.02	0.23	-46.46	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant1	5720	-19.14	5.02	-	-14.12	Peak	15.6	Pass
NVNT	n40	5755	Ant1	5720	-41.37	5.02	0.23	-36.12	Average	15.6	Pass
NVNT	n40	5755	Ant1	5725	-17.15	5.02	-	-12.13	Peak	27	Pass
NVNT	n40	5755	Ant1	5725	-41.17	5.02	0.23	-35.92	Average	27	Pass
NVNT	n40	5795	Ant1	5850	-38.05	5.02	-	-33.03	Peak	27	Pass
NVNT	n40	5795	Ant1	5850	-51.31	5.02	0.22	-46.07	Average	27	Pass
NVNT	n40	5795	Ant1	5855	-33.09	5.02	-	-28.07	Peak	15.6	Pass
NVNT	n40	5795	Ant1	5855	-52.16	5.02	0.22	-46.92	Average	15.6	Pass
NVNT	n40	5795	Ant1	5875	-47.97	5.02	-	-42.95	Peak	10	Pass
NVNT	n40	5795	Ant1	5875	-55.49	5.02	0.22	-50.25	Average	10	Pass
NVNT	n40	5795	Ant1	5925	-47.58	5.02	-	-42.56	Peak	-27	Pass
NVNT	n40	5795	Ant1	5925	-56.55	5.02	0.22	-51.31	Average	-27	Pass
NVNT	ac20	5745	Ant1	5650	-48.71	5.02	-	-43.69	Peak	-27	Pass
NVNT	ac20	5745	Ant1	5650	-56.2	5.02	0.11	-51.07	Average	-27	Pass
NVNT	ac20	5745	Ant1	5700	-43.51	5.02	-	-38.49	Peak	10	Pass
NVNT	ac20	5745	Ant1	5700	-54.98	5.02	0.11	-49.85	Average	10	Pass
NVNT	ac20	5745	Ant1	5720	-37.46	5.02	-	-32.44	Peak	15.6	Pass
NVNT	ac20	5745	Ant1	5720	-50.48	5.02	0.11	-45.35	Average	15.6	Pass
NVNT	ac20	5745	Ant1	5725	-31.81	5.02	-	-26.79	Peak	27	Pass
NVNT	ac20	5745	Ant1	5725	-47.22	5.02	0.11	-42.09	Average	27	Pass
NVNT	ac20	5825	Ant1	5850	-37.66	5.02	-	-32.64	Peak	27	Pass
NVNT	ac20	5825	Ant1	5850	-49.69	5.02	0.11	-44.56	Average	27	Pass
NVNT	ac20	5825	Ant1	5855	-39.36	5.02	-	-34.34	Peak	15.6	Pass
NVNT	ac20	5825	Ant1	5855	-52.33	5.02	0.11	-47.2	Average	15.6	Pass
NVNT	ac20	5825	Ant1	5875	-47.1	5.02	-	-42.08	Peak	10	Pass
NVNT	ac20	5825	Ant1	5875	-54.92	5.02	0.11	-49.79	Average	10	Pass
NVNT	ac20	5825	Ant1	5925	-47.57	5.02	-	-42.55	Peak	-27	Pass
NVNT	ac20	5825	Ant1	5925	-55.88	5.02	0.11	-50.75	Average	-27	Pass
NVNT	ac40	5755	Ant1	5650	-49.22	5.02	-	-44.2	Peak	-27	Pass
NVNT	ac40	5755	Ant1	5650	-54.95	5.02	0.22	-49.71	Average	-27	Pass
NVNT	ac40	5755	Ant1	5700	-40.73	5.02	-	-35.71	Peak	10	Pass
NVNT	ac40	5755	Ant1	5700	-51.57	5.02	0.22	-46.33	Average	10	Pass
NVNT	ac40	5755	Ant1	5720	-28.86	5.02	-	-23.84	Peak	15.6	Pass
NVNT	ac40	5755	Ant1	5720	-42.14	5.02	0.22	-36.9	Average	15.6	Pass
NVNT	ac40	5755	Ant1	5725	-31.33	5.02	-	-26.31	Peak	27	Pass
NVNT	ac40	5755	Ant1	5725	-41.31	5.02	0.22	-36.07	Average	27	Pass
NVNT	ac40	5795	Ant1	5850	-35.42	5.02	-	-30.4	Peak	27	Pass
NVNT	ac40	5795	Ant1	5850	-50.05	5.02	0.23	-44.8	Average	27	Pass
NVNT	ac40	5795	Ant1	5855	-40.23	5.02	-	-35.21	Peak	15.6	Pass
NVNT	ac40	5795	Ant1	5855	-52.04	5.02	0.23	-46.79	Average	15.6	Pass
NVNT	ac40	5795	Ant1	5875	-41.08	5.02	-	-36.06	Peak	10	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5795	Ant1	5875	-54.62	5.02	0.23	-49.37	Average	10	Pass
NVNT	ac40	5795	Ant1	5925	-49.12	5.02	-	-44.1	Peak	-27	Pass
NVNT	ac40	5795	Ant1	5925	-56.06	5.02	0.23	-50.81	Average	-27	Pass
NVNT	ac80	5775	Ant1	5850	-30.54	5.02	-	-25.52	Peak	27	Pass
NVNT	ac80	5775	Ant1	5850	-43.62	5.02	0.43	-38.17	Average	27	Pass
NVNT	ac80	5775	Ant1	5855	-34.05	5.02	-	-29.03	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5855	-44.39	5.02	0.43	-38.94	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5875	-37.07	5.02	-	-32.05	Peak	10	Pass
NVNT	ac80	5775	Ant1	5875	-47.91	5.02	0.43	-42.46	Average	10	Pass
NVNT	ac80	5775	Ant1	5925	-43.88	5.02	-	-38.86	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5925	-55.48	5.02	0.43	-50.03	Average	-27	Pass
NVNT	ac80	5775	Ant1	5650	-43.67	5.02	-	-38.65	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5650	-53.98	5.02	0.43	-48.53	Average	-27	Pass
NVNT	ac80	5775	Ant1	5700	-31.55	5.02	-	-26.53	Peak	10	Pass
NVNT	ac80	5775	Ant1	5700	-44.06	5.02	0.43	-38.61	Average	10	Pass
NVNT	ac80	5775	Ant1	5720	-30.89	5.02	-	-25.87	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5720	-39.82	5.02	0.43	-34.37	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5725	-31.58	5.02	-	-26.56	Peak	27	Pass
NVNT	ac80	5775	Ant1	5725	-40.5	5.02	0.43	-35.05	Average	27	Pass
NVNT	ax20	5745	Ant1	5650	-47.4	5.02	-	-42.38	Peak	-27	Pass
NVNT	ax20	5745	Ant1	5650	-55.86	5.02	0.11	-50.73	Average	-27	Pass
NVNT	ax20	5745	Ant1	5700	-44.22	5.02	-	-39.2	Peak	10	Pass
NVNT	ax20	5745	Ant1	5700	-54.58	5.02	0.11	-49.45	Average	10	Pass
NVNT	ax20	5745	Ant1	5720	-35.37	5.02	-	-30.35	Peak	15.6	Pass
NVNT	ax20	5745	Ant1	5720	-50.16	5.02	0.11	-45.03	Average	15.6	Pass
NVNT	ax20	5745	Ant1	5725	-23.59	5.02	-	-18.57	Peak	27	Pass
NVNT	ax20	5745	Ant1	5725	-46.2	5.02	0.11	-41.07	Average	27	Pass
NVNT	ax20	5825	Ant1	5850	-35.62	5.02	-	-30.6	Peak	27	Pass
NVNT	ax20	5825	Ant1	5850	-47.37	5.02	0.11	-42.24	Average	27	Pass
NVNT	ax20	5825	Ant1	5855	-39.48	5.02	-	-34.46	Peak	15.6	Pass
NVNT	ax20	5825	Ant1	5855	-51.77	5.02	0.11	-46.64	Average	15.6	Pass
NVNT	ax20	5825	Ant1	5875	-45.13	5.02	-	-40.11	Peak	10	Pass
NVNT	ax20	5825	Ant1	5875	-54.6	5.02	0.11	-49.47	Average	10	Pass
NVNT	ax20	5825	Ant1	5925	-46.6	5.02	-	-41.58	Peak	-27	Pass
NVNT	ax20	5825	Ant1	5925	-55.12	5.02	0.11	-49.99	Average	-27	Pass
NVNT	ax40	5755	Ant1	5650	-47.35	5.02	-	-42.33	Peak	-27	Pass
NVNT	ax40	5755	Ant1	5650	-55.62	5.02	0.21	-50.39	Average	-27	Pass
NVNT	ax40	5755	Ant1	5700	-44.86	5.02	-	-39.84	Peak	10	Pass
NVNT	ax40	5755	Ant1	5700	-52.34	5.02	0.21	-47.11	Average	10	Pass
NVNT	ax40	5755	Ant1	5720	-30.39	5.02	-	-25.37	Peak	15.6	Pass
NVNT	ax40	5755	Ant1	5720	-42.81	5.02	0.21	-37.58	Average	15.6	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5755	Ant1	5725	-27.93	5.02	-	-22.91	Peak	27	Pass
NVNT	ax40	5755	Ant1	5725	-42.04	5.02	0.21	-36.81	Average	27	Pass
NVNT	ax40	5795	Ant1	5850	-41.75	5.02	-	-36.73	Peak	27	Pass
NVNT	ax40	5795	Ant1	5850	-51.23	5.02	0.22	-45.99	Average	27	Pass
NVNT	ax40	5795	Ant1	5855	-38.77	5.02	-	-33.75	Peak	15.6	Pass
NVNT	ax40	5795	Ant1	5855	-52.92	5.02	0.22	-47.68	Average	15.6	Pass
NVNT	ax40	5795	Ant1	5875	-47.13	5.02	-	-42.11	Peak	10	Pass
NVNT	ax40	5795	Ant1	5875	-55.25	5.02	0.22	-50.01	Average	10	Pass
NVNT	ax40	5795	Ant1	5925	-47.56	5.02	-	-42.54	Peak	-27	Pass
NVNT	ax40	5795	Ant1	5925	-56.01	5.02	0.22	-50.77	Average	-27	Pass
NVNT	ax80	5775	Ant1	5850	-31.78	5.02	-	-26.76	Peak	27	Pass
NVNT	ax80	5775	Ant1	5850	-44.16	5.02	0.43	-38.71	Average	27	Pass
NVNT	ax80	5775	Ant1	5855	-32.77	5.02	-	-27.75	Peak	15.6	Pass
NVNT	ax80	5775	Ant1	5855	-45.14	5.02	0.43	-39.69	Average	15.6	Pass
NVNT	ax80	5775	Ant1	5875	-35.54	5.02	-	-30.52	Peak	10	Pass
NVNT	ax80	5775	Ant1	5875	-47.93	5.02	0.43	-42.48	Average	10	Pass
NVNT	ax80	5775	Ant1	5925	-45.66	5.02	-	-40.64	Peak	-27	Pass
NVNT	ax80	5775	Ant1	5925	-55.7	5.02	0.43	-50.25	Average	-27	Pass
NVNT	ax80	5775	Ant1	5650	-46.07	5.02	-	-41.05	Peak	-27	Pass
NVNT	ax80	5775	Ant1	5650	-54.48	5.02	0.43	-49.03	Average	-27	Pass
NVNT	ax80	5775	Ant1	5700	-35.6	5.02	-	-30.58	Peak	10	Pass
NVNT	ax80	5775	Ant1	5700	-44.31	5.02	0.43	-38.86	Average	10	Pass
NVNT	ax80	5775	Ant1	5720	-27.69	5.02	-	-22.67	Peak	15.6	Pass
NVNT	ax80	5775	Ant1	5720	-41.33	5.02	0.43	-35.88	Average	15.6	Pass
NVNT	ax80	5775	Ant1	5725	-28.18	5.02	-	-23.16	Peak	27	Pass
NVNT	ax80	5775	Ant1	5725	-40.62	5.02	0.43	-35.17	Average	27	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs

Restrict Band NVNT a 5745MHz Ant1 Peak

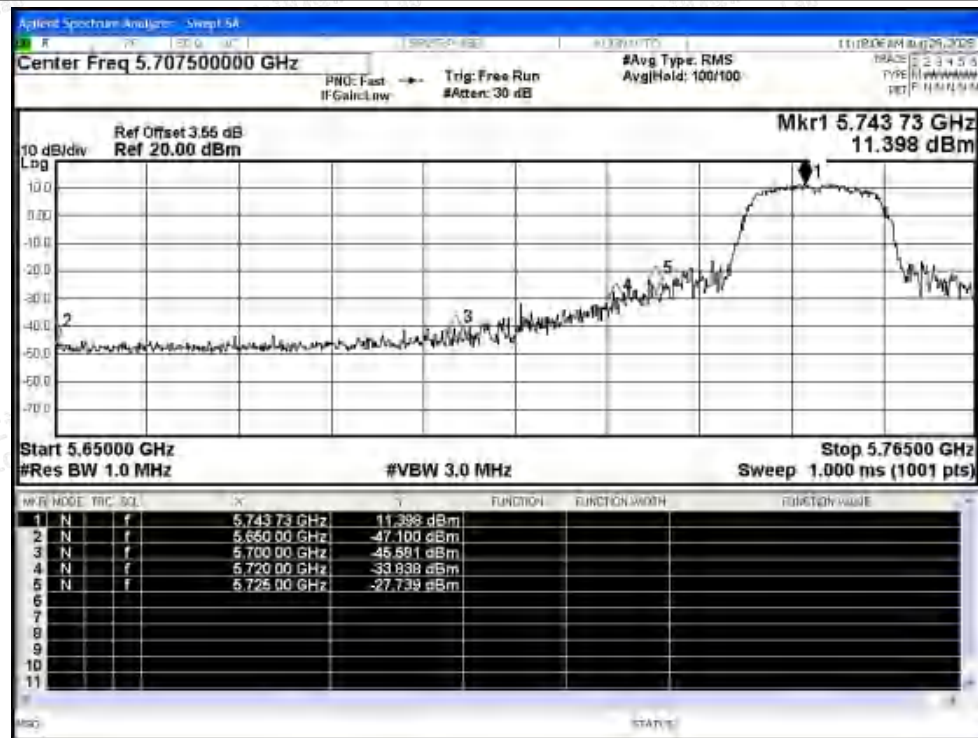

Restrict Band NVNT a 5745MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant1 Peak

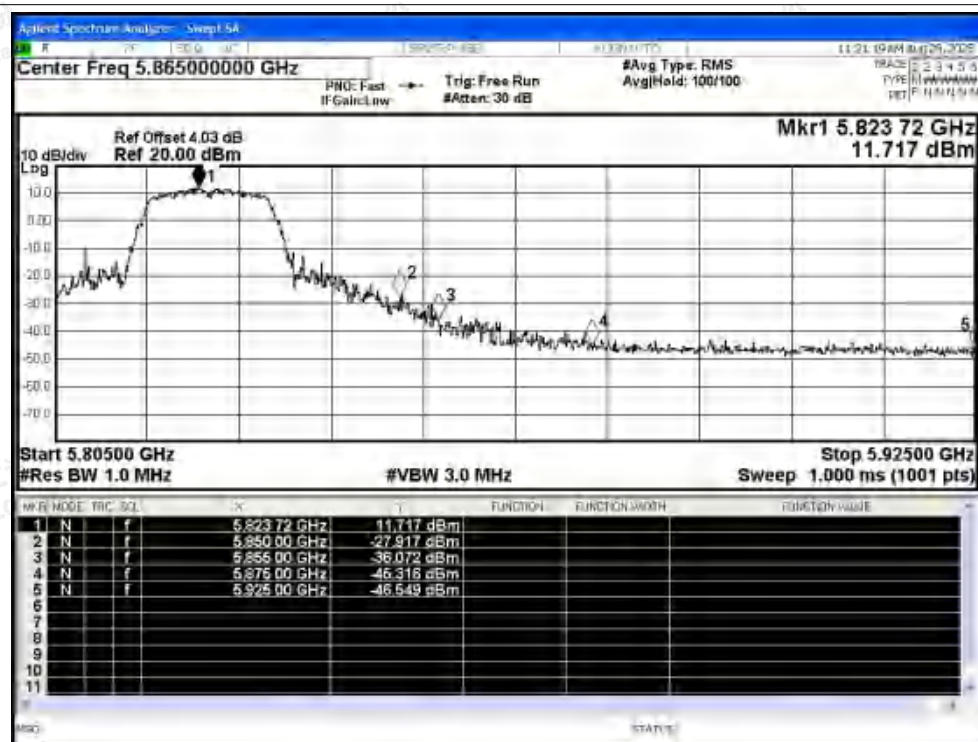


Restrict Band NVNT a 5825MHz Ant1 Average

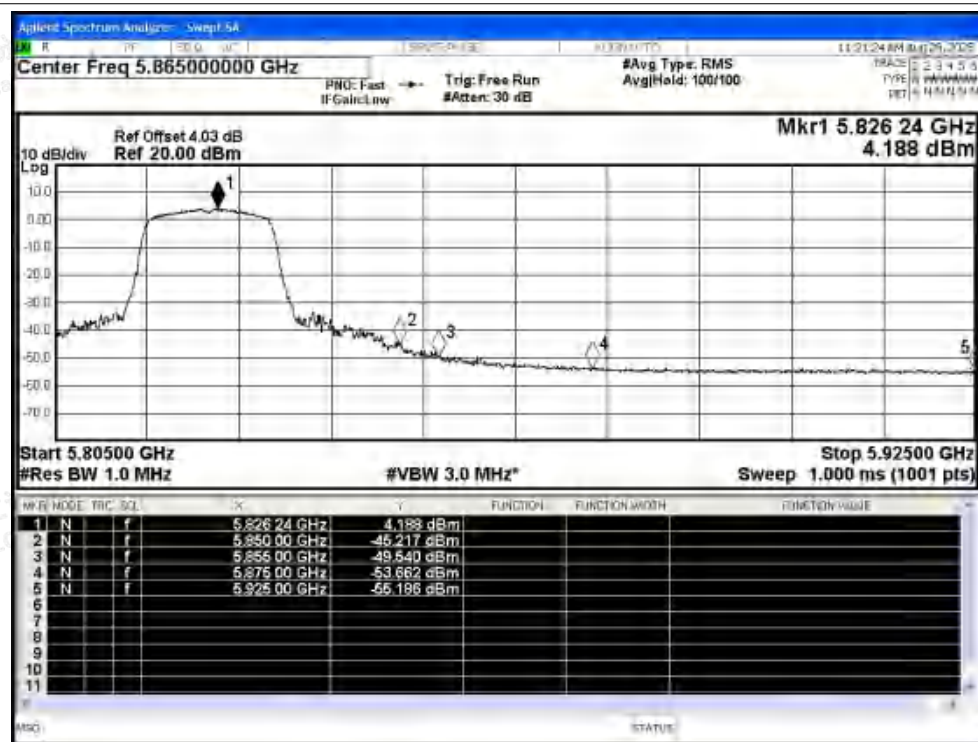



Restrict Band NVNT n20 5745MHz Ant1 Peak

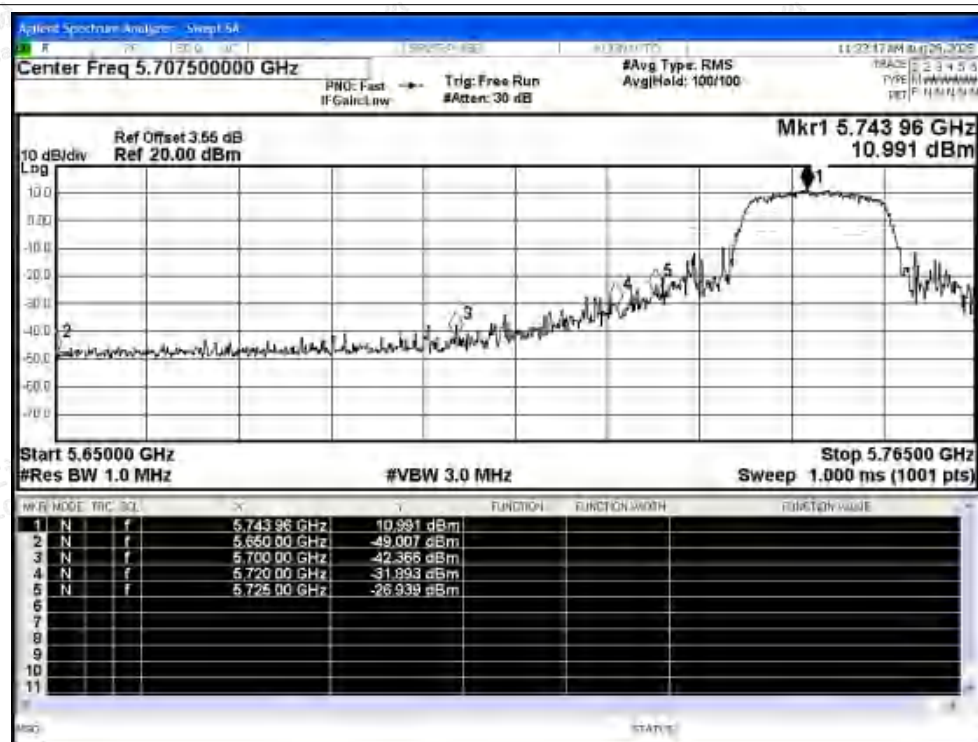

Restrict Band NVNT n20 5745MHz Ant1 Average






Restrict Band NVNT n20 5825MHz Ant1 Peak



Restrict Band NVNT n20 5825MHz Ant1 Average

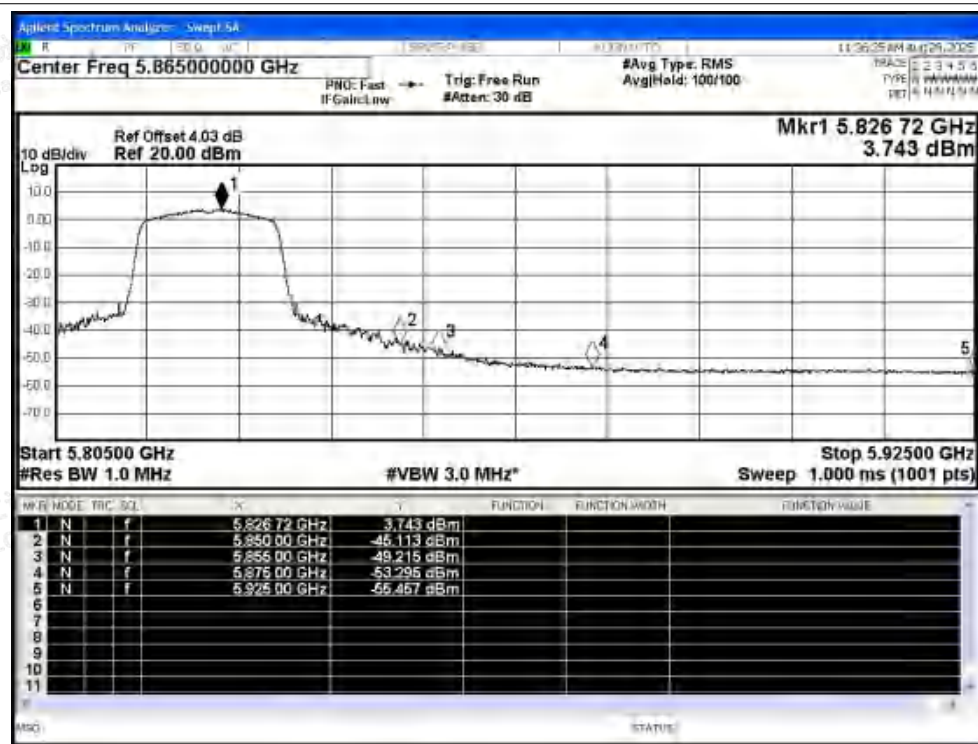


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant1 Peak

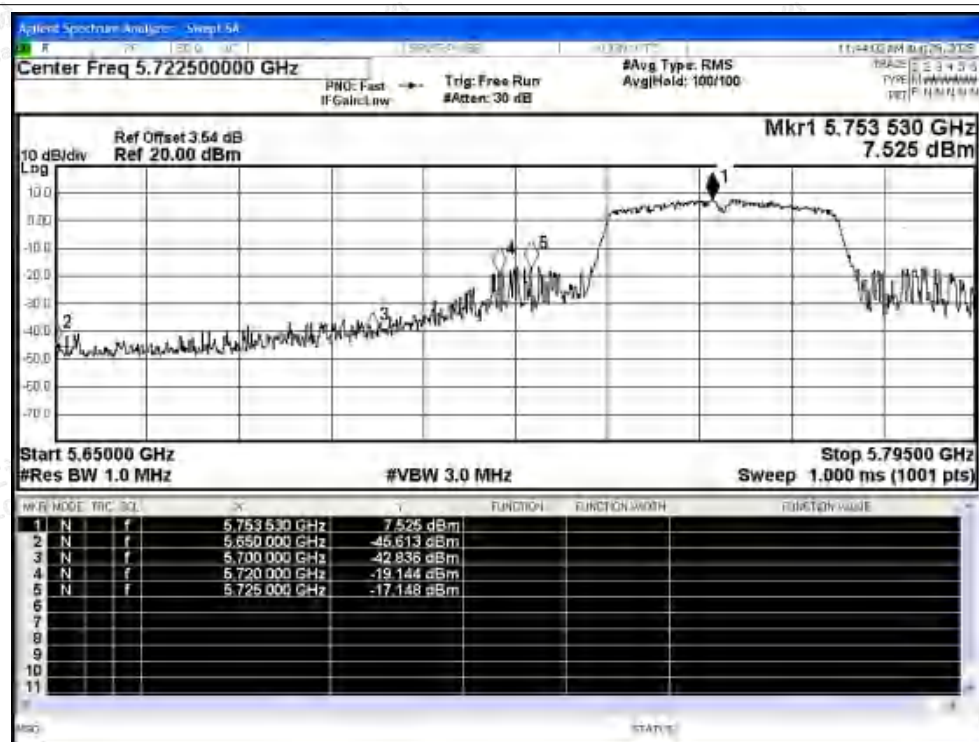

Restrict Band NVNT n40 5755MHz Ant1 Average

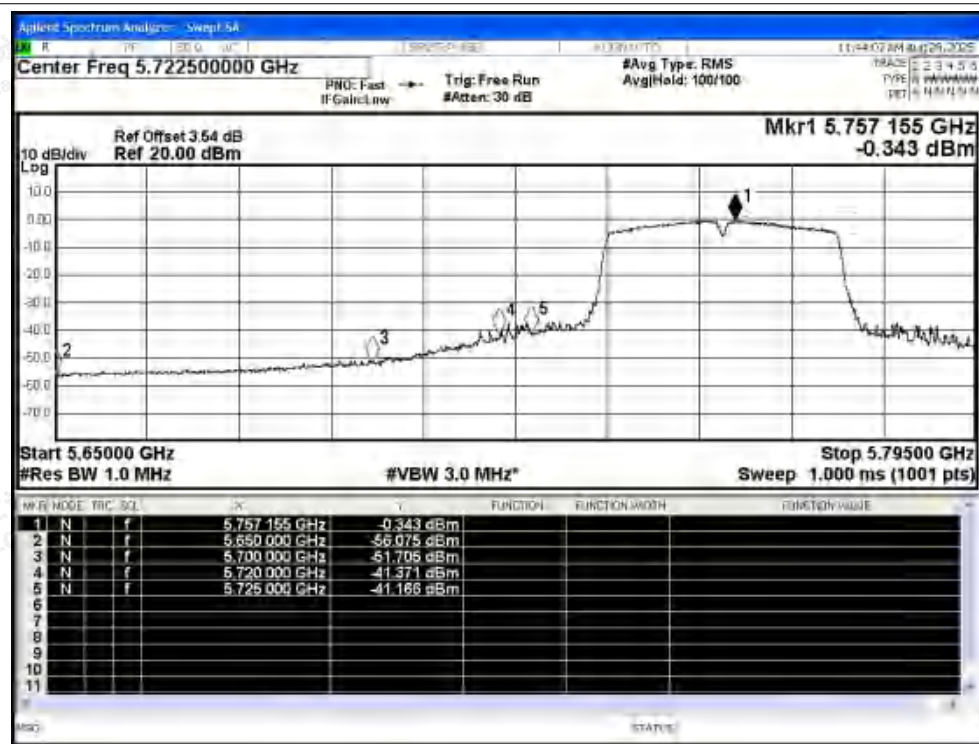


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant1 Peak



Restrict Band NVNT n40 5795MHz Ant1 Average

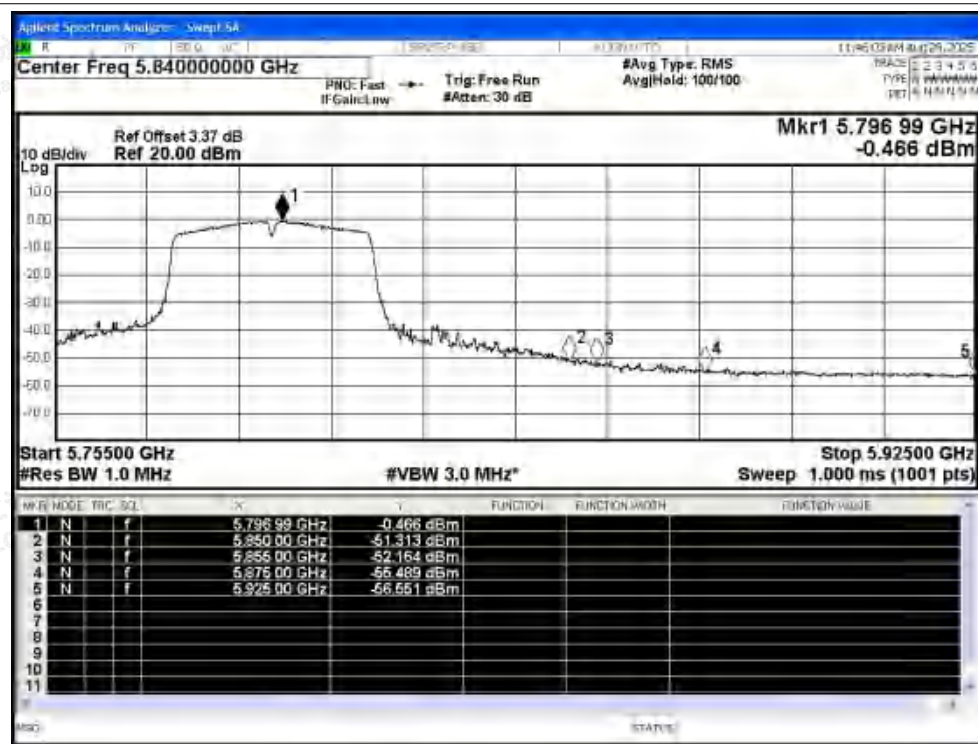

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant1 Peak

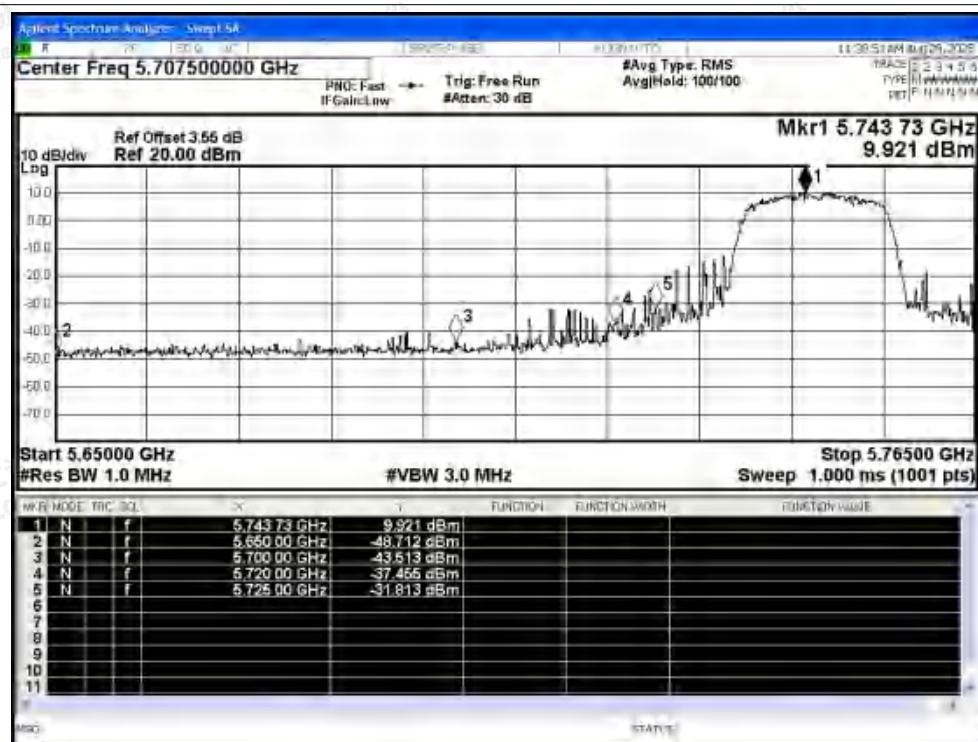

Restrict Band NVNT ac20 5745MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant1 Peak

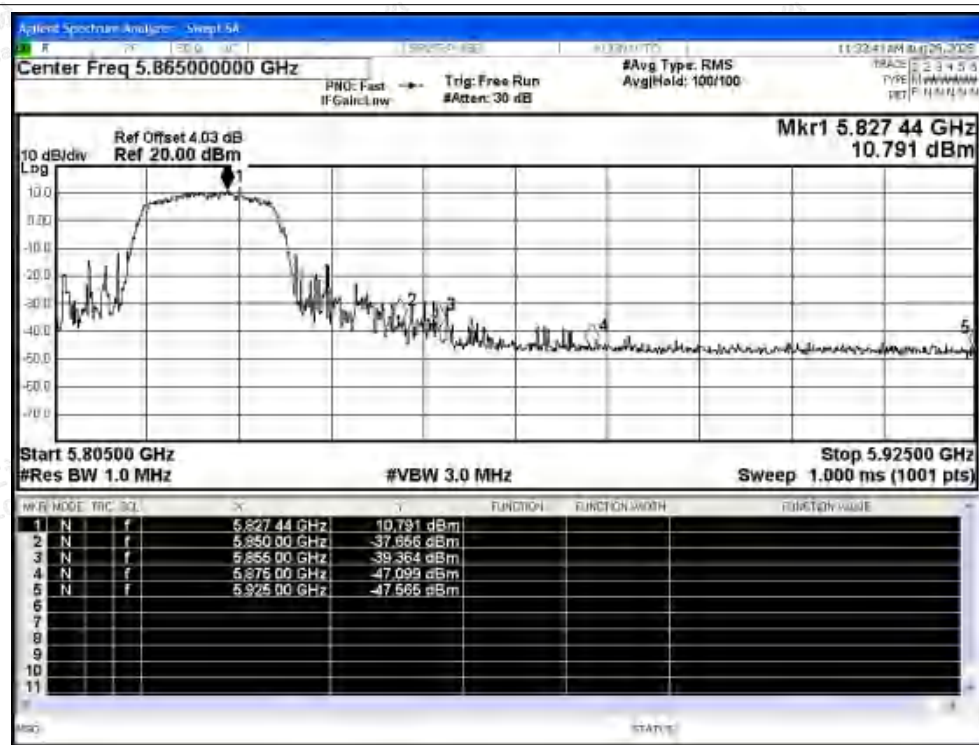

Restrict Band NVNT ac20 5825MHz Ant1 Average

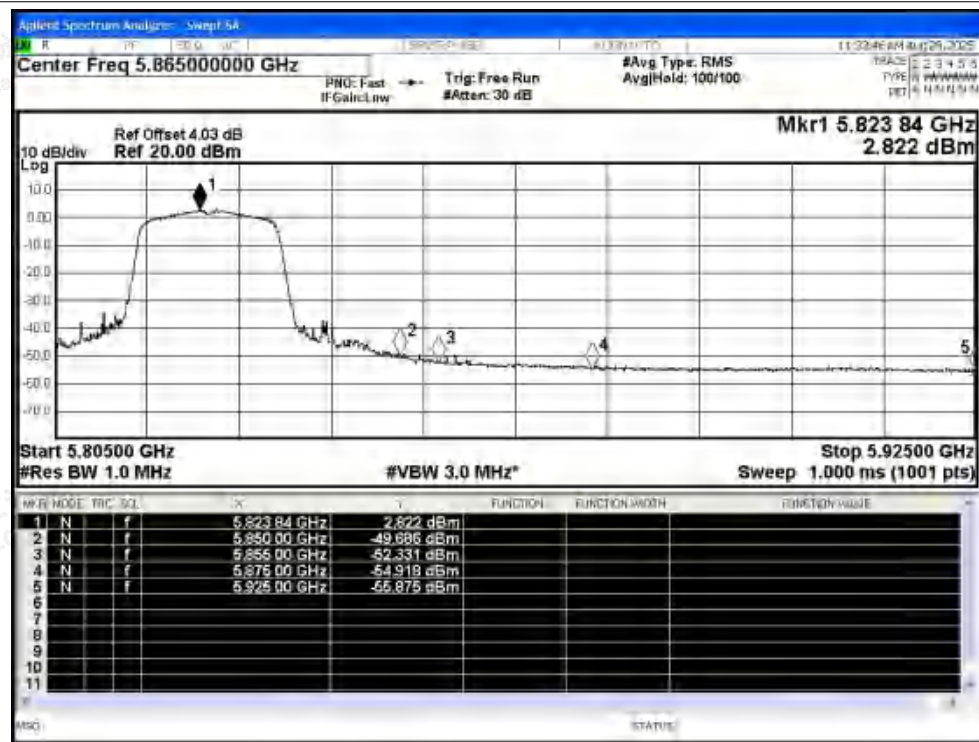

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant1 Peak



Restrict Band NVNT ac40 5755MHz Ant1 Average

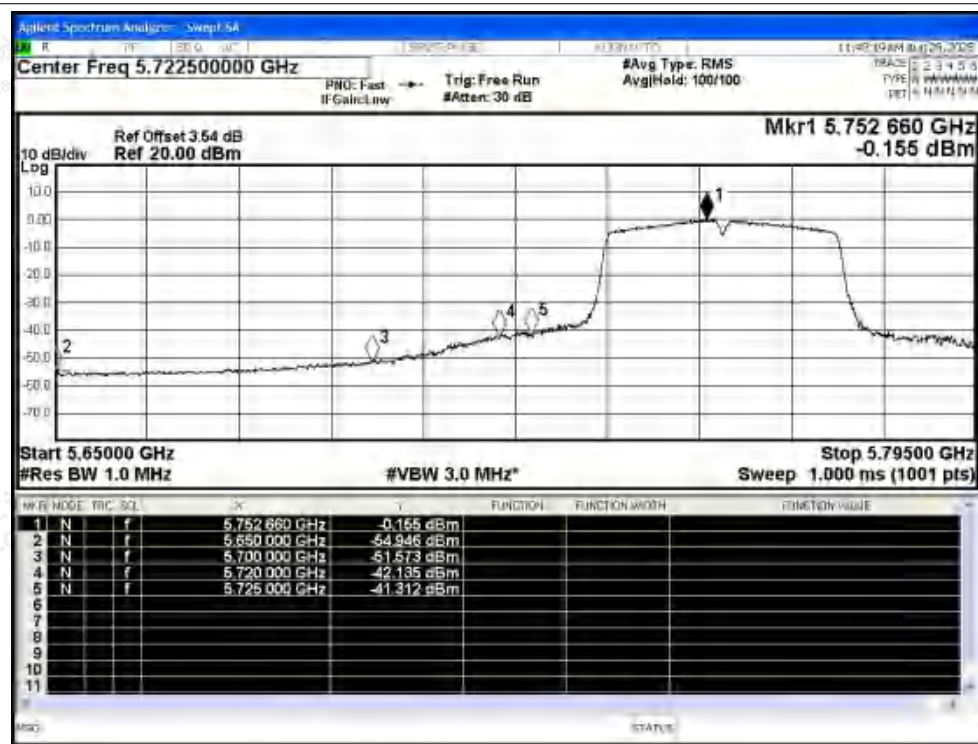


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant1 Peak

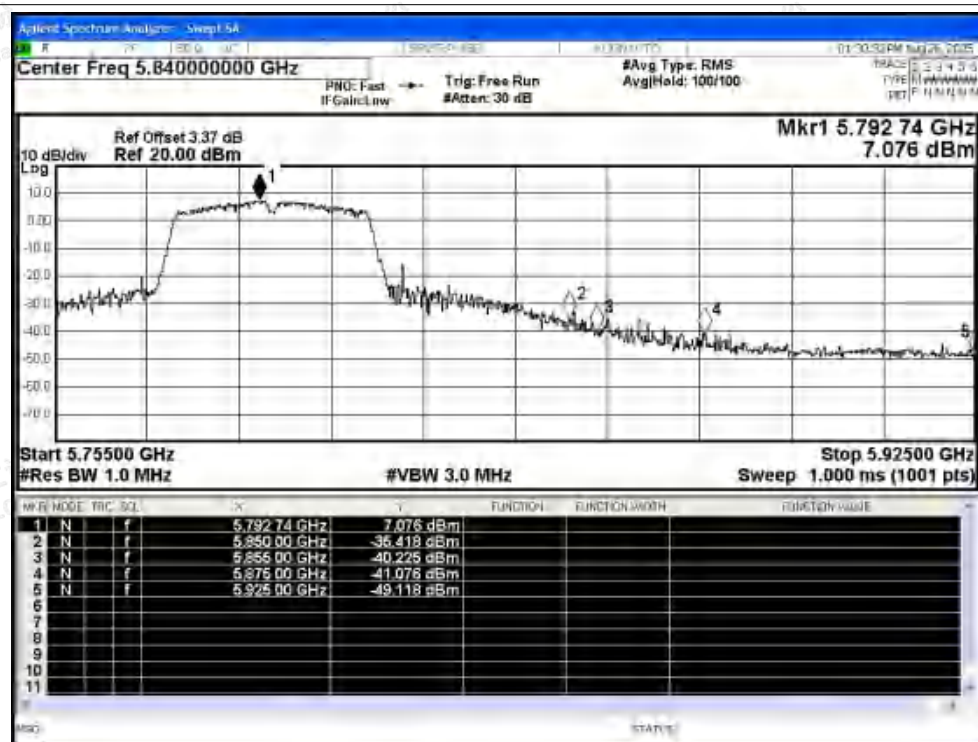

Restrict Band NVNT ac40 5795MHz Ant1 Average

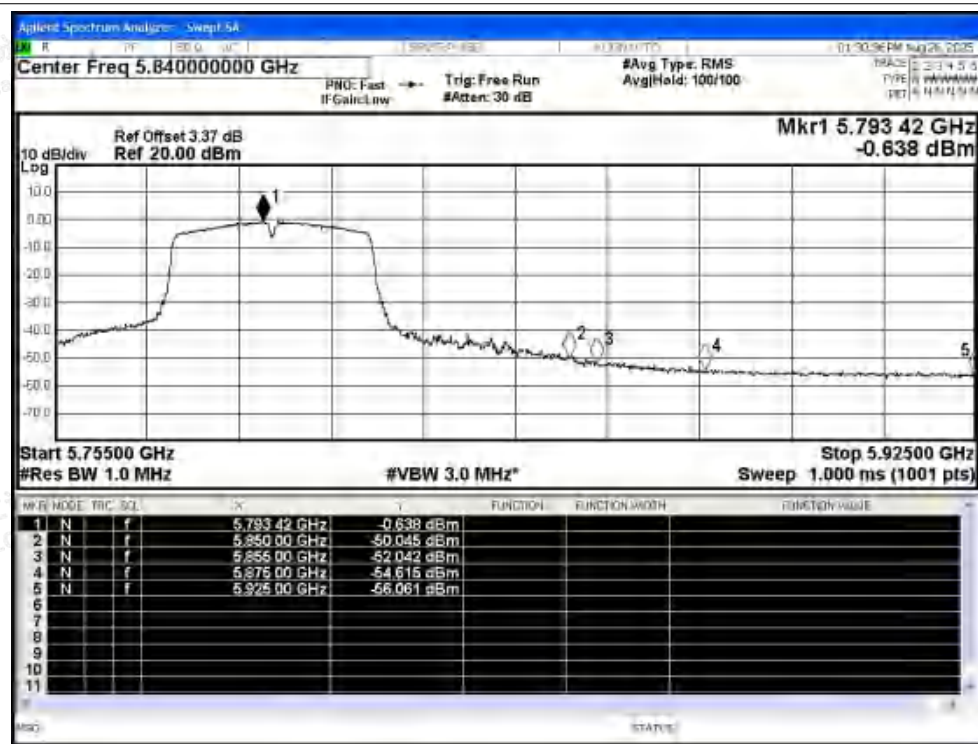

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant1 Peak

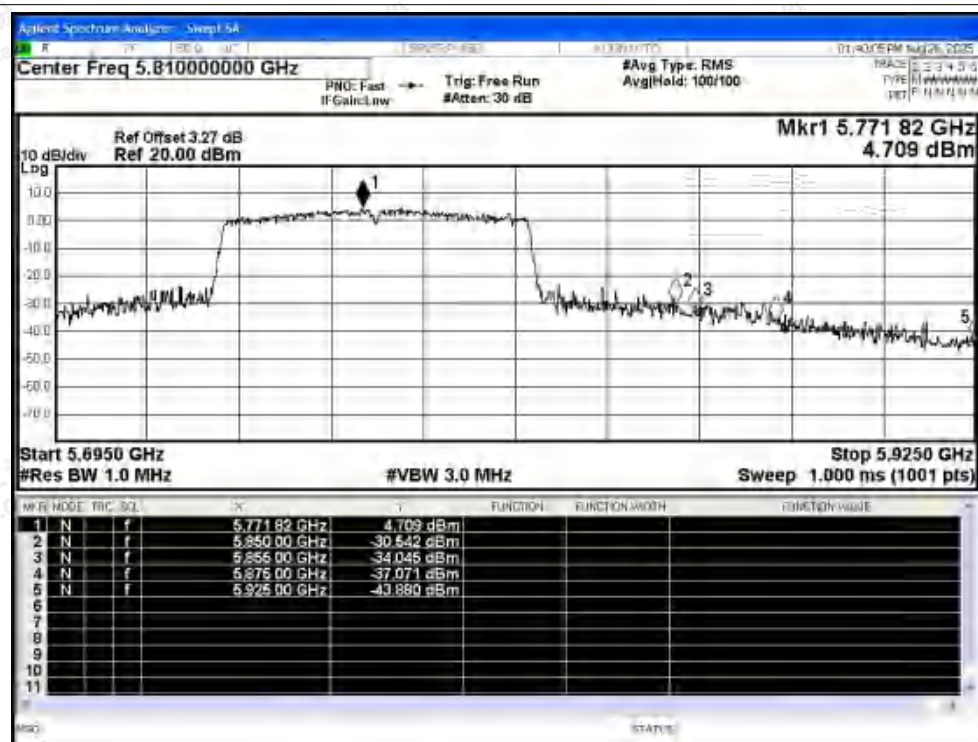


Restrict Band NVNT ac80 5775MHz Ant1 Average

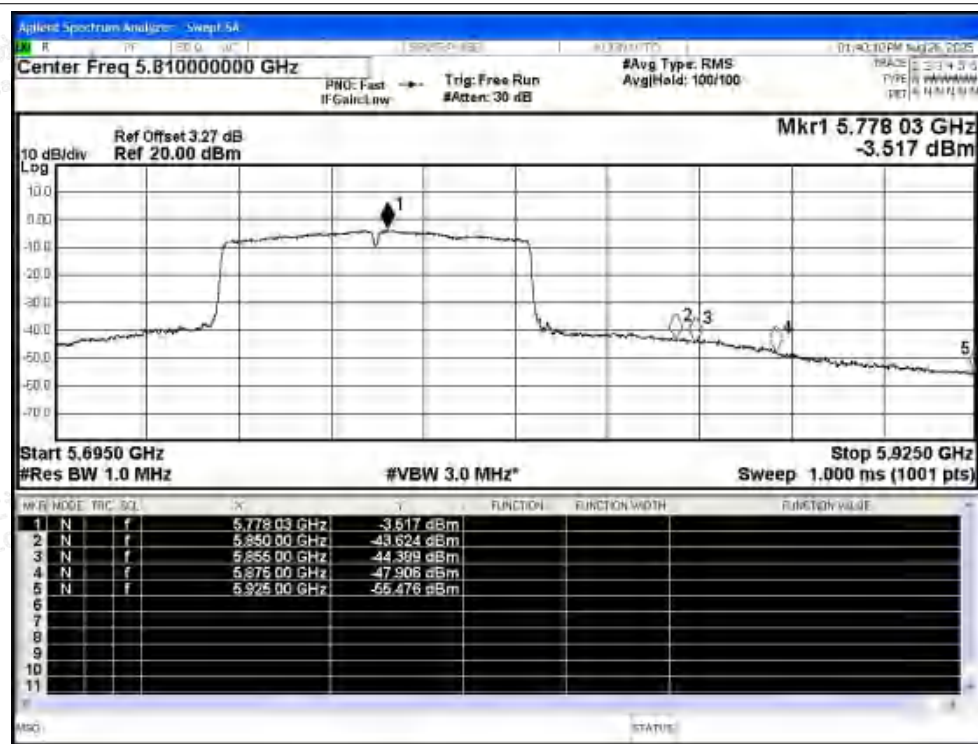




Restrict Band NVNT ac80 5775MHz Ant1 Peak

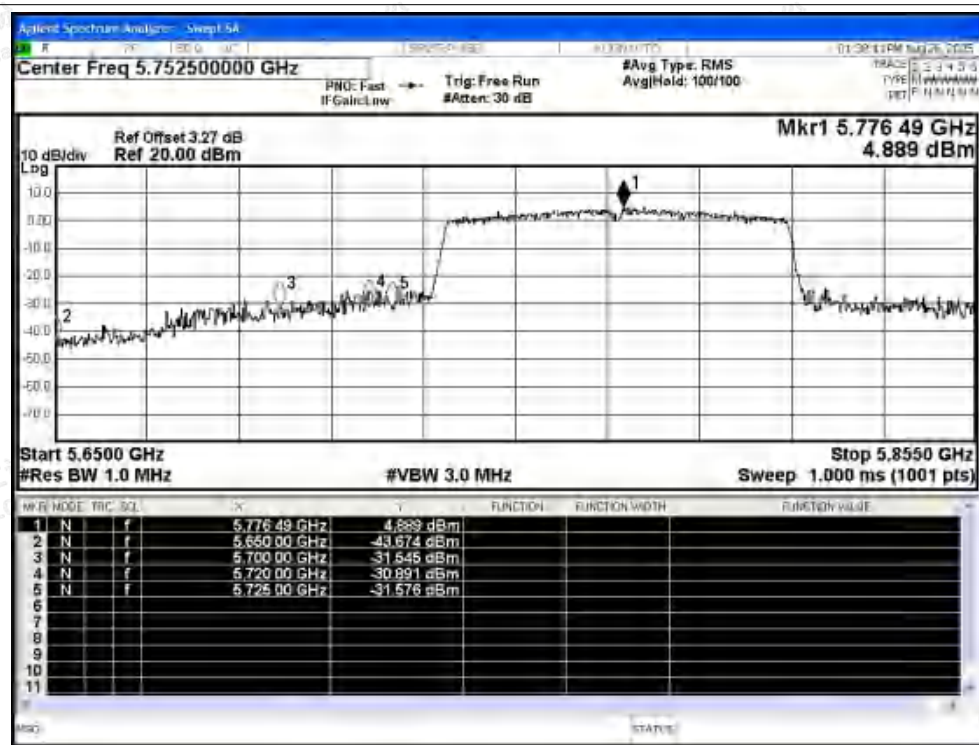

Restrict Band NVNT ac80 5775MHz Ant1 Average

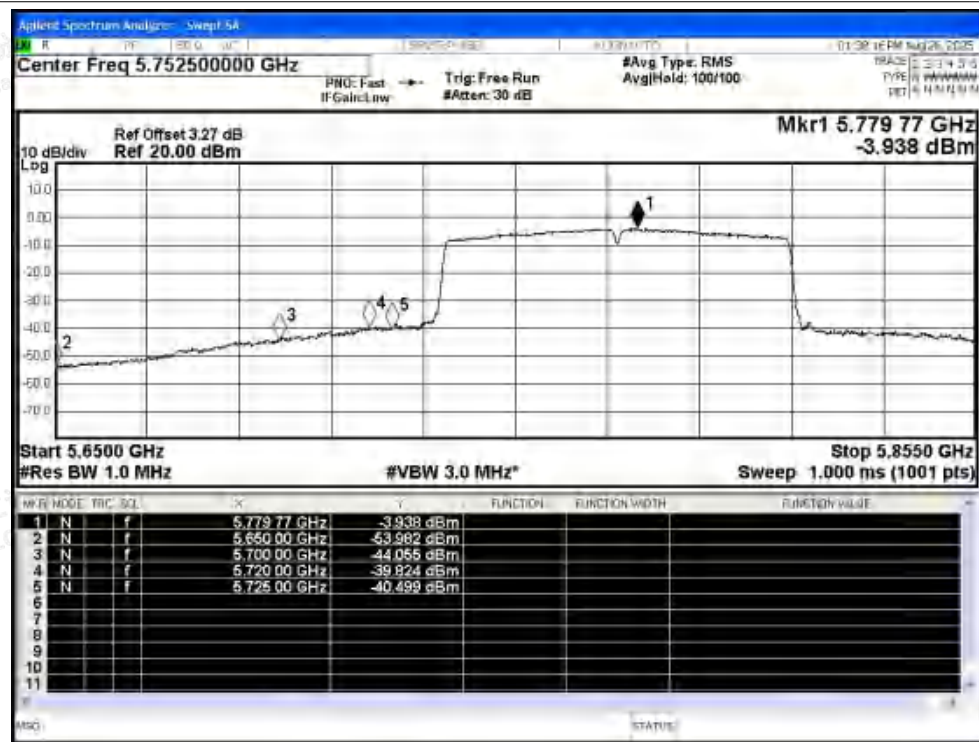

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant1 Peak



Restrict Band NVNT ax20 5745MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant1 Peak

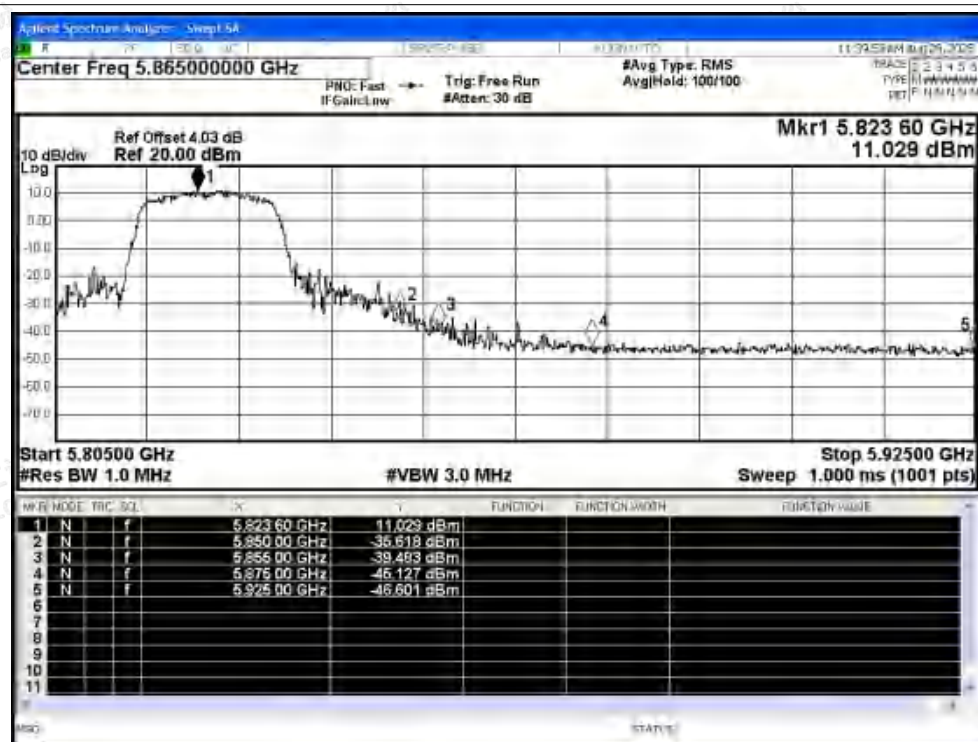

Restrict Band NVNT ax20 5825MHz Ant1 Average

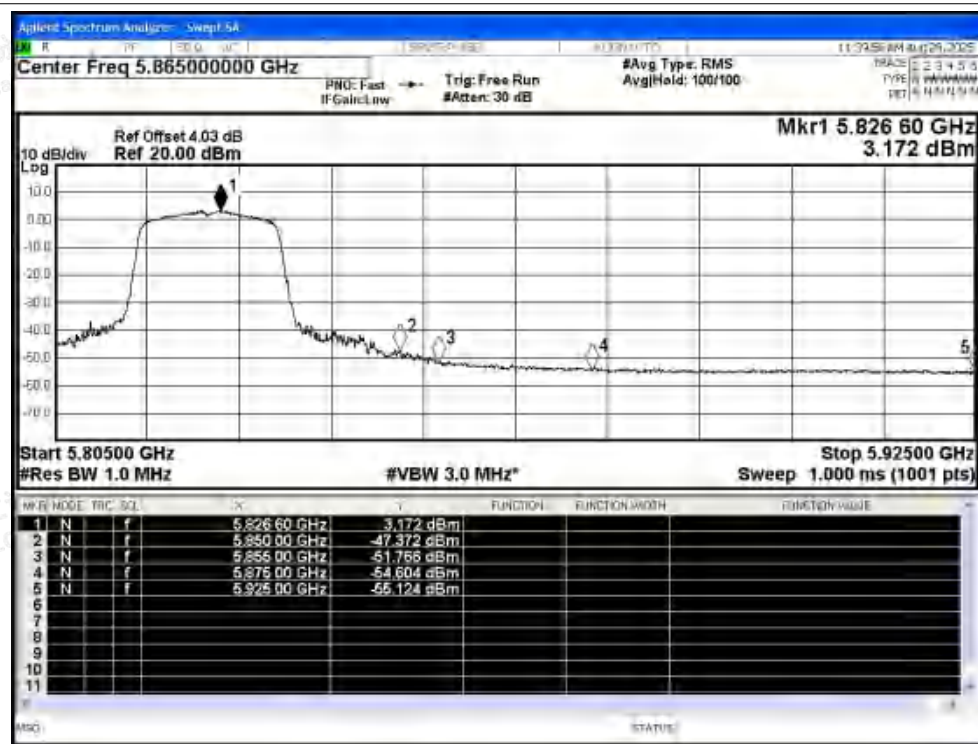

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant1 Peak




Restrict Band NVNT ax40 5755MHz Ant1 Average

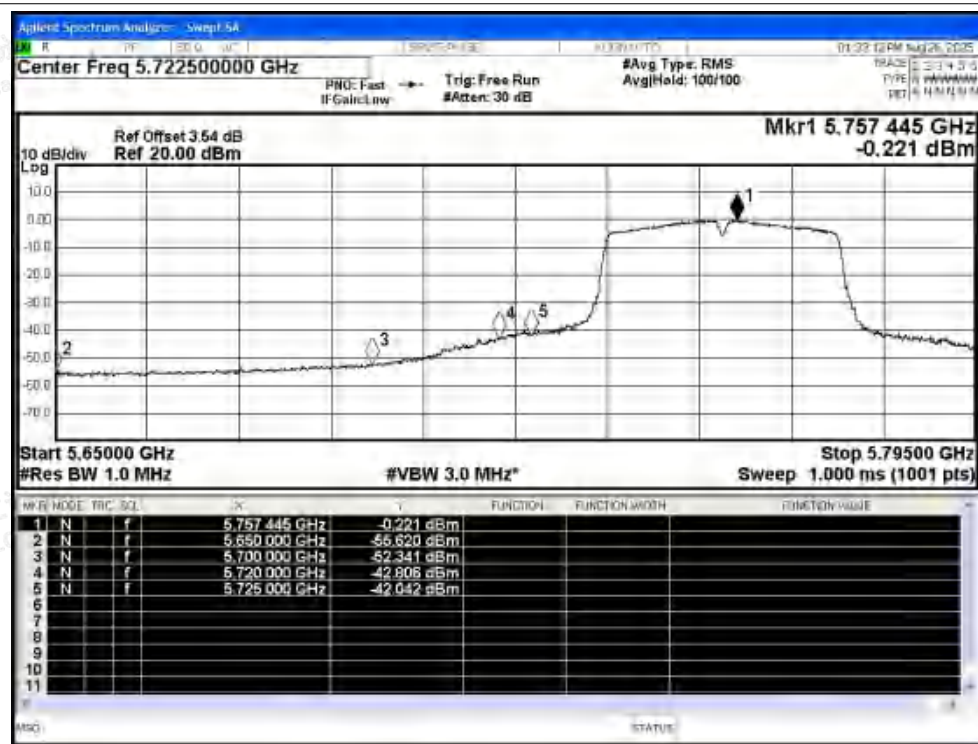




Restrict Band NVNT ax40 5795MHz Ant1 Peak

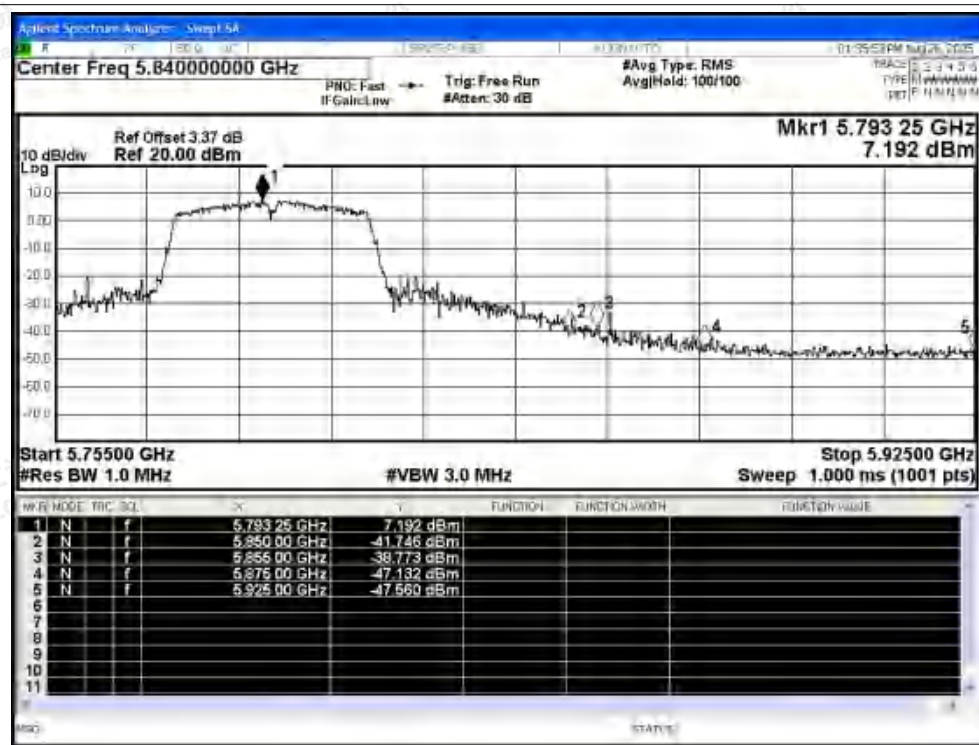

Restrict Band NVNT ax40 5795MHz Ant1 Average

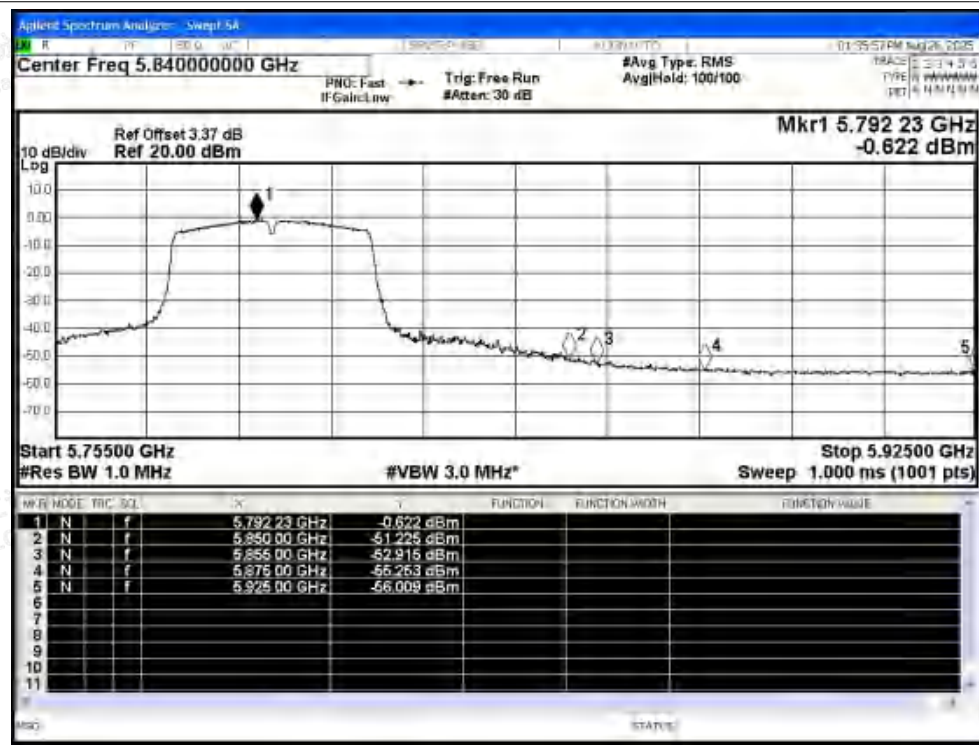


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant1 Peak

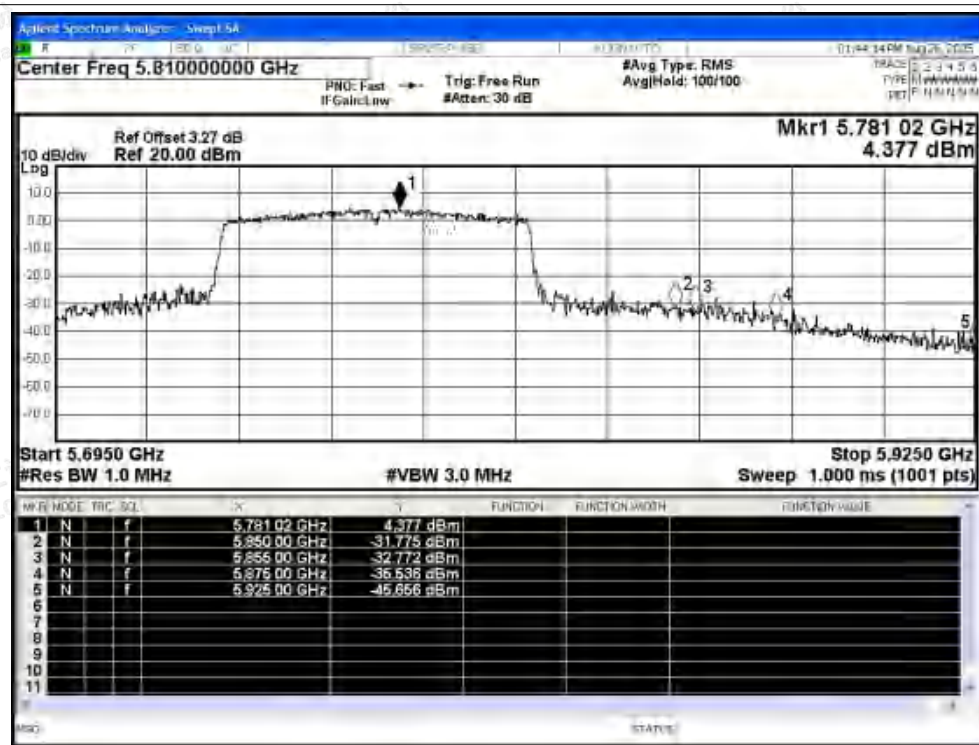

Restrict Band NVNT ax80 5775MHz Ant1 Average

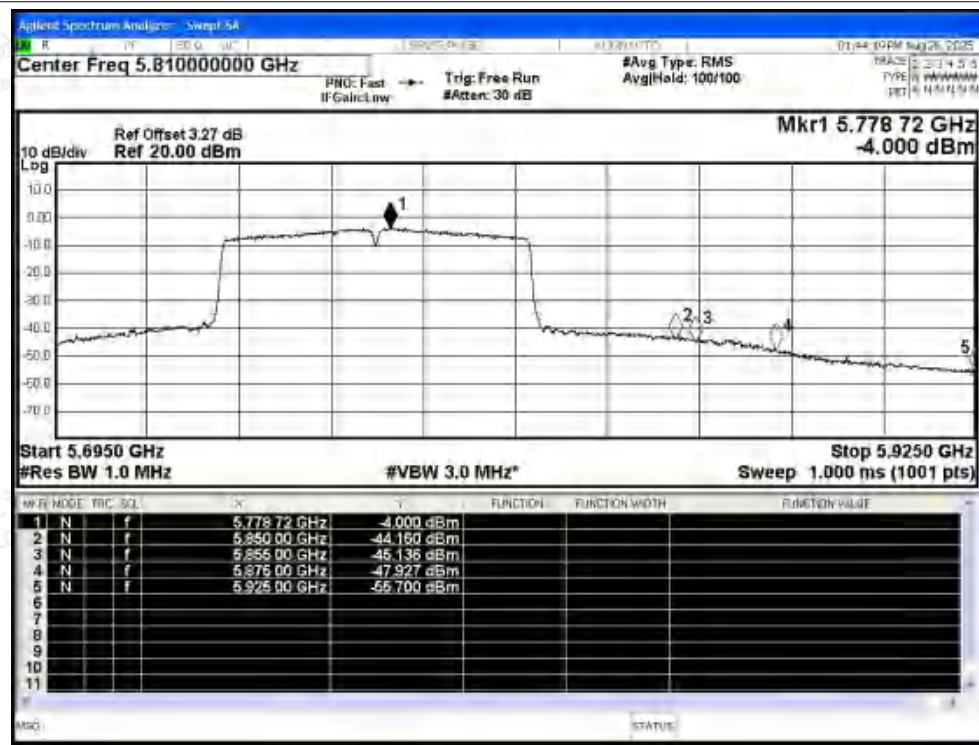


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant1 Peak

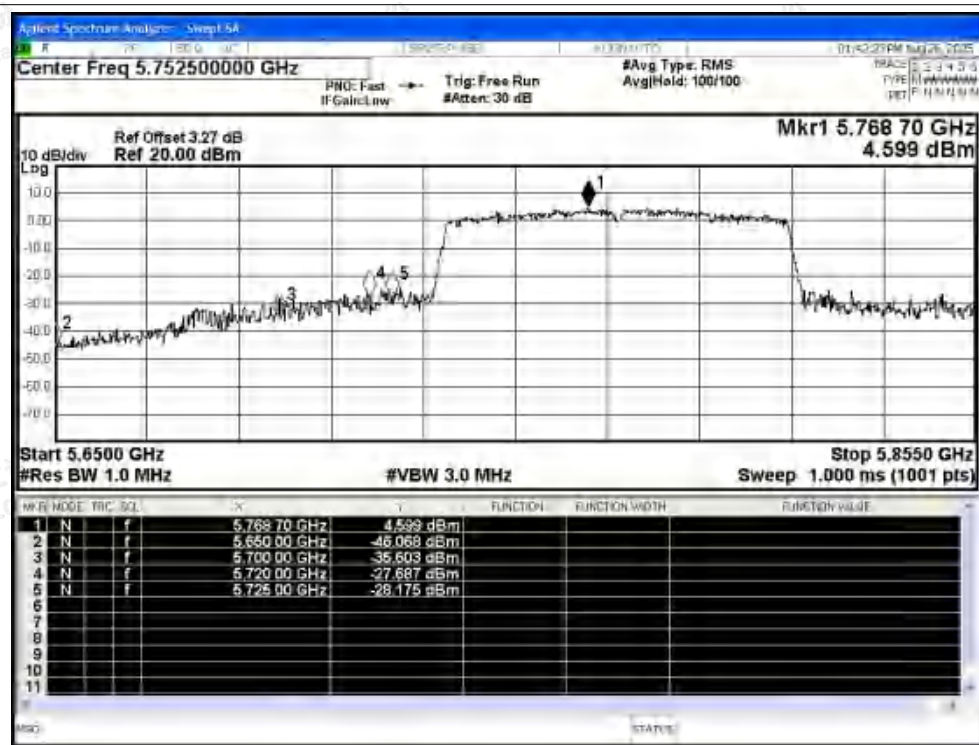

Restrict Band NVNT ax80 5775MHz Ant1 Average

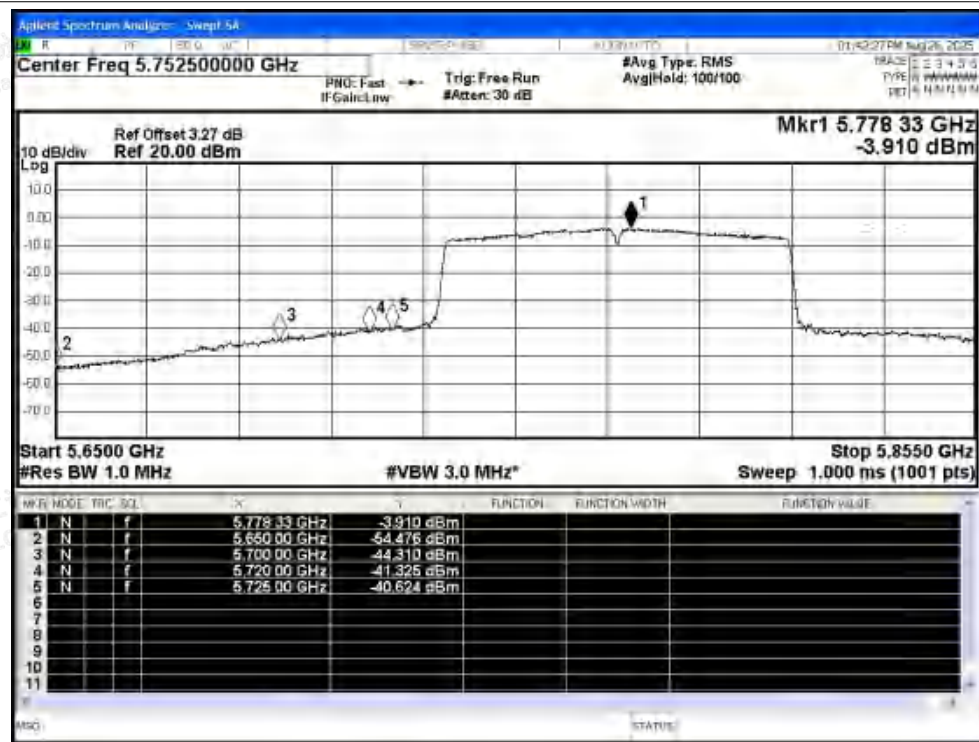


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant2	5650	-47.12	5.02	-	-42.1	Peak	-27	Pass
NVNT	a	5745	Ant2	5650	-55.47	5.02	0.1	-50.35	Average	-27	Pass
NVNT	a	5745	Ant2	5700	-41.21	5.02	-	-36.19	Peak	10	Pass
NVNT	a	5745	Ant2	5700	-54.35	5.02	0.1	-49.23	Average	10	Pass
NVNT	a	5745	Ant2	5720	-32.78	5.02	-	-27.76	Peak	15.6	Pass
NVNT	a	5745	Ant2	5720	-48.21	5.02	0.1	-43.09	Average	15.6	Pass
NVNT	a	5745	Ant2	5725	-29.83	5.02	-	-24.81	Peak	27	Pass
NVNT	a	5745	Ant2	5725	-43	5.02	0.1	-37.88	Average	27	Pass
NVNT	a	5825	Ant2	5850	-34.69	5.02	-	-29.67	Peak	27	Pass
NVNT	a	5825	Ant2	5850	-47.56	5.02	0.1	-42.44	Average	27	Pass
NVNT	a	5825	Ant2	5855	-41.03	5.02	-	-36.01	Peak	15.6	Pass
NVNT	a	5825	Ant2	5855	-50.62	5.02	0.1	-45.5	Average	15.6	Pass
NVNT	a	5825	Ant2	5875	-45.05	5.02	-	-40.03	Peak	10	Pass
NVNT	a	5825	Ant2	5875	-54.37	5.02	0.1	-49.25	Average	10	Pass
NVNT	a	5825	Ant2	5925	-47.95	5.02	-	-42.93	Peak	-27	Pass
NVNT	a	5825	Ant2	5925	-54.85	5.02	0.1	-49.73	Average	-27	Pass
NVNT	n20	5745	Ant2	5650	-46.97	5.02	-	-41.95	Peak	-27	Pass
NVNT	n20	5745	Ant2	5650	-56.18	5.02	0.11	-51.05	Average	-27	Pass
NVNT	n20	5745	Ant2	5700	-45.3	5.02	-	-40.28	Peak	10	Pass
NVNT	n20	5745	Ant2	5700	-54.69	5.02	0.11	-49.56	Average	10	Pass
NVNT	n20	5745	Ant2	5720	-36.69	5.02	-	-31.67	Peak	15.6	Pass
NVNT	n20	5745	Ant2	5720	-51.13	5.02	0.11	-46	Average	15.6	Pass
NVNT	n20	5745	Ant2	5725	-32.58	5.02	-	-27.56	Peak	27	Pass
NVNT	n20	5745	Ant2	5725	-43.48	5.02	0.11	-38.35	Average	27	Pass
NVNT	n20	5825	Ant2	5850	-31.5	5.02	-	-26.48	Peak	27	Pass
NVNT	n20	5825	Ant2	5850	-46.24	5.02	0.11	-41.11	Average	27	Pass
NVNT	n20	5825	Ant2	5855	-38.63	5.02	-	-33.61	Peak	15.6	Pass
NVNT	n20	5825	Ant2	5855	-49.93	5.02	0.11	-44.8	Average	15.6	Pass
NVNT	n20	5825	Ant2	5875	-46.16	5.02	-	-41.14	Peak	10	Pass
NVNT	n20	5825	Ant2	5875	-53.77	5.02	0.11	-48.64	Average	10	Pass
NVNT	n20	5825	Ant2	5925	-46.35	5.02	-	-41.33	Peak	-27	Pass
NVNT	n20	5825	Ant2	5925	-55.21	5.02	0.11	-50.08	Average	-27	Pass
NVNT	n40	5755	Ant2	5650	-45.94	5.02	-	-40.92	Peak	-27	Pass
NVNT	n40	5755	Ant2	5650	-55.99	5.02	0.22	-50.75	Average	-27	Pass
NVNT	n40	5755	Ant2	5700	-37.02	5.02	-	-32	Peak	10	Pass
NVNT	n40	5755	Ant2	5700	-51.21	5.02	0.22	-45.97	Average	10	Pass
NVNT	n40	5755	Ant2	5720	-26.71	5.02	-	-21.69	Peak	15.6	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant2	5720	-42.66	5.02	0.22	-37.42	Average	15.6	Pass
NVNT	n40	5755	Ant2	5725	-28.07	5.02	-	-23.05	Peak	27	Pass
NVNT	n40	5755	Ant2	5725	-40.68	5.02	0.22	-35.44	Average	27	Pass
NVNT	n40	5795	Ant2	5850	-39.39	5.02	-	-34.37	Peak	27	Pass
NVNT	n40	5795	Ant2	5850	-50.69	5.02	0.22	-45.45	Average	27	Pass
NVNT	n40	5795	Ant2	5855	-34.46	5.02	-	-29.44	Peak	15.6	Pass
NVNT	n40	5795	Ant2	5855	-52.21	5.02	0.22	-46.97	Average	15.6	Pass
NVNT	n40	5795	Ant2	5875	-37.47	5.02	-	-32.45	Peak	10	Pass
NVNT	n40	5795	Ant2	5875	-54.32	5.02	0.22	-49.08	Average	10	Pass
NVNT	n40	5795	Ant2	5925	-48.43	5.02	-	-43.41	Peak	-27	Pass
NVNT	n40	5795	Ant2	5925	-56.09	5.02	0.22	-50.85	Average	-27	Pass
NVNT	ac20	5745	Ant2	5650	-47.71	5.02	-	-42.69	Peak	-27	Pass
NVNT	ac20	5745	Ant2	5650	-56.24	5.02	0.11	-51.11	Average	-27	Pass
NVNT	ac20	5745	Ant2	5700	-45.95	5.02	-	-40.93	Peak	10	Pass
NVNT	ac20	5745	Ant2	5700	-54.01	5.02	0.11	-48.88	Average	10	Pass
NVNT	ac20	5745	Ant2	5720	-36.73	5.02	-	-31.71	Peak	15.6	Pass
NVNT	ac20	5745	Ant2	5720	-50.35	5.02	0.11	-45.22	Average	15.6	Pass
NVNT	ac20	5745	Ant2	5725	-33.93	5.02	-	-28.91	Peak	27	Pass
NVNT	ac20	5745	Ant2	5725	-46.69	5.02	0.11	-41.56	Average	27	Pass
NVNT	ac20	5825	Ant2	5850	-38.18	5.02	-	-33.16	Peak	27	Pass
NVNT	ac20	5825	Ant2	5850	-50	5.02	0.11	-44.87	Average	27	Pass
NVNT	ac20	5825	Ant2	5855	-33.9	5.02	-	-28.88	Peak	15.6	Pass
NVNT	ac20	5825	Ant2	5855	-51.2	5.02	0.11	-46.07	Average	15.6	Pass
NVNT	ac20	5825	Ant2	5875	-45.37	5.02	-	-40.35	Peak	10	Pass
NVNT	ac20	5825	Ant2	5875	-54.32	5.02	0.11	-49.19	Average	10	Pass
NVNT	ac20	5825	Ant2	5925	-47.51	5.02	-	-42.49	Peak	-27	Pass
NVNT	ac20	5825	Ant2	5925	-55.14	5.02	0.11	-50.01	Average	-27	Pass
NVNT	ac40	5755	Ant2	5650	-47.62	5.02	-	-42.6	Peak	-27	Pass
NVNT	ac40	5755	Ant2	5650	-55.98	5.02	0.21	-50.75	Average	-27	Pass
NVNT	ac40	5755	Ant2	5700	-39.38	5.02	-	-34.36	Peak	10	Pass
NVNT	ac40	5755	Ant2	5700	-51.03	5.02	0.21	-45.8	Average	10	Pass
NVNT	ac40	5755	Ant2	5720	-28.88	5.02	-	-23.86	Peak	15.6	Pass
NVNT	ac40	5755	Ant2	5720	-42.85	5.02	0.21	-37.62	Average	15.6	Pass
NVNT	ac40	5755	Ant2	5725	-26.54	5.02	-	-21.52	Peak	27	Pass
NVNT	ac40	5755	Ant2	5725	-41.53	5.02	0.21	-36.3	Average	27	Pass
NVNT	ac40	5795	Ant2	5850	-37.62	5.02	-	-32.6	Peak	27	Pass
NVNT	ac40	5795	Ant2	5850	-51.11	5.02	0.22	-45.87	Average	27	Pass
NVNT	ac40	5795	Ant2	5855	-39.38	5.02	-	-34.36	Peak	15.6	Pass
NVNT	ac40	5795	Ant2	5855	-52.53	5.02	0.22	-47.29	Average	15.6	Pass
NVNT	ac40	5795	Ant2	5875	-43.83	5.02	-	-38.81	Peak	10	Pass
NVNT	ac40	5795	Ant2	5875	-54.95	5.02	0.22	-49.71	Average	10	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5795	Ant2	5925	-48.77	5.02	-	-43.75	Peak	-27	Pass
NVNT	ac40	5795	Ant2	5925	-56.27	5.02	0.22	-51.03	Average	-27	Pass
NVNT	ac80	5775	Ant2	5850	-31.7	5.02	-	-26.68	Peak	27	Pass
NVNT	ac80	5775	Ant2	5850	-44.58	5.02	0.43	-39.13	Average	27	Pass
NVNT	ac80	5775	Ant2	5855	-30.78	5.02	-	-25.76	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5855	-44.62	5.02	0.43	-39.17	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5875	-34.43	5.02	-	-29.41	Peak	10	Pass
NVNT	ac80	5775	Ant2	5875	-49.2	5.02	0.43	-43.75	Average	10	Pass
NVNT	ac80	5775	Ant2	5925	-45.99	5.02	-	-40.97	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5925	-55.87	5.02	0.43	-50.42	Average	-27	Pass
NVNT	ac80	5775	Ant2	5650	-45.83	5.02	-	-40.81	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5650	-53.45	5.02	0.43	-48	Average	-27	Pass
NVNT	ac80	5775	Ant2	5700	-34.04	5.02	-	-29.02	Peak	10	Pass
NVNT	ac80	5775	Ant2	5700	-43.36	5.02	0.43	-37.91	Average	10	Pass
NVNT	ac80	5775	Ant2	5720	-29.07	5.02	-	-24.05	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5720	-39.65	5.02	0.43	-34.2	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5725	-30.32	5.02	-	-25.3	Peak	27	Pass
NVNT	ac80	5775	Ant2	5725	-39.5	5.02	0.43	-34.05	Average	27	Pass
NVNT	ax20	5745	Ant2	5650	-48.34	5.02	-	-43.32	Peak	-27	Pass
NVNT	ax20	5745	Ant2	5650	-55.63	5.02	0.11	-50.5	Average	-27	Pass
NVNT	ax20	5745	Ant2	5700	-45.34	5.02	-	-40.32	Peak	10	Pass
NVNT	ax20	5745	Ant2	5700	-54.84	5.02	0.11	-49.71	Average	10	Pass
NVNT	ax20	5745	Ant2	5720	-38.29	5.02	-	-33.27	Peak	15.6	Pass
NVNT	ax20	5745	Ant2	5720	-50.92	5.02	0.11	-45.79	Average	15.6	Pass
NVNT	ax20	5745	Ant2	5725	-36.8	5.02	-	-31.78	Peak	27	Pass
NVNT	ax20	5745	Ant2	5725	-46.26	5.02	0.11	-41.13	Average	27	Pass
NVNT	ax20	5825	Ant2	5850	-28.73	5.02	-	-23.71	Peak	27	Pass
NVNT	ax20	5825	Ant2	5850	-45.09	5.02	0.11	-39.96	Average	27	Pass
NVNT	ax20	5825	Ant2	5855	-36.63	5.02	-	-31.61	Peak	15.6	Pass
NVNT	ax20	5825	Ant2	5855	-50.32	5.02	0.11	-45.19	Average	15.6	Pass
NVNT	ax20	5825	Ant2	5875	-43.97	5.02	-	-38.95	Peak	10	Pass
NVNT	ax20	5825	Ant2	5875	-53.93	5.02	0.11	-48.8	Average	10	Pass
NVNT	ax20	5825	Ant2	5925	-45.95	5.02	-	-40.93	Peak	-27	Pass
NVNT	ax20	5825	Ant2	5925	-55.1	5.02	0.11	-49.97	Average	-27	Pass
NVNT	ax40	5755	Ant2	5650	-48.52	5.02	-	-43.5	Peak	-27	Pass
NVNT	ax40	5755	Ant2	5650	-55.83	5.02	0.21	-50.6	Average	-27	Pass
NVNT	ax40	5755	Ant2	5700	-39.02	5.02	-	-34	Peak	10	Pass
NVNT	ax40	5755	Ant2	5700	-50.26	5.02	0.21	-45.03	Average	10	Pass
NVNT	ax40	5755	Ant2	5720	-27.3	5.02	-	-22.28	Peak	15.6	Pass
NVNT	ax40	5755	Ant2	5720	-41.49	5.02	0.21	-36.26	Average	15.6	Pass
NVNT	ax40	5755	Ant2	5725	-25.74	5.02	-	-20.72	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5755	Ant2	5725	-42.1	5.02	0.21	-36.87	Average	27	Pass
NVNT	ax40	5795	Ant2	5850	-35.81	5.02	-	-30.79	Peak	27	Pass
NVNT	ax40	5795	Ant2	5850	-50.8	5.02	0.21	-45.57	Average	27	Pass
NVNT	ax40	5795	Ant2	5855	-40.63	5.02	-	-35.61	Peak	15.6	Pass
NVNT	ax40	5795	Ant2	5855	-53.27	5.02	0.21	-48.04	Average	15.6	Pass
NVNT	ax40	5795	Ant2	5875	-46.04	5.02	-	-41.02	Peak	10	Pass
NVNT	ax40	5795	Ant2	5875	-55.82	5.02	0.21	-50.59	Average	10	Pass
NVNT	ax40	5795	Ant2	5925	-48.1	5.02	-	-43.08	Peak	-27	Pass
NVNT	ax40	5795	Ant2	5925	-55.65	5.02	0.21	-50.42	Average	-27	Pass
NVNT	ax80	5775	Ant2	5850	-33.78	5.02	-	-28.76	Peak	27	Pass
NVNT	ax80	5775	Ant2	5850	-45.23	5.02	0.43	-39.78	Average	27	Pass
NVNT	ax80	5775	Ant2	5855	-37.19	5.02	-	-32.17	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5855	-47.93	5.02	0.43	-42.48	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5875	-36.05	5.02	-	-31.03	Peak	10	Pass
NVNT	ax80	5775	Ant2	5875	-51.75	5.02	0.43	-46.3	Average	10	Pass
NVNT	ax80	5775	Ant2	5925	-47.81	5.02	-	-42.79	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5925	-55.63	5.02	0.43	-50.18	Average	-27	Pass
NVNT	ax80	5775	Ant2	5650	-46.94	5.02	-	-41.92	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5650	-55.31	5.02	0.43	-49.86	Average	-27	Pass
NVNT	ax80	5775	Ant2	5700	-34.7	5.02	-	-29.68	Peak	10	Pass
NVNT	ax80	5775	Ant2	5700	-46.44	5.02	0.43	-40.99	Average	10	Pass
NVNT	ax80	5775	Ant2	5720	-27.81	5.02	-	-22.79	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5720	-42.23	5.02	0.43	-36.78	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5725	-32.09	5.02	-	-27.07	Peak	27	Pass
NVNT	ax80	5775	Ant2	5725	-41.99	5.02	0.43	-36.54	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs

Restrict Band NVNT a 5745MHz Ant2 Peak

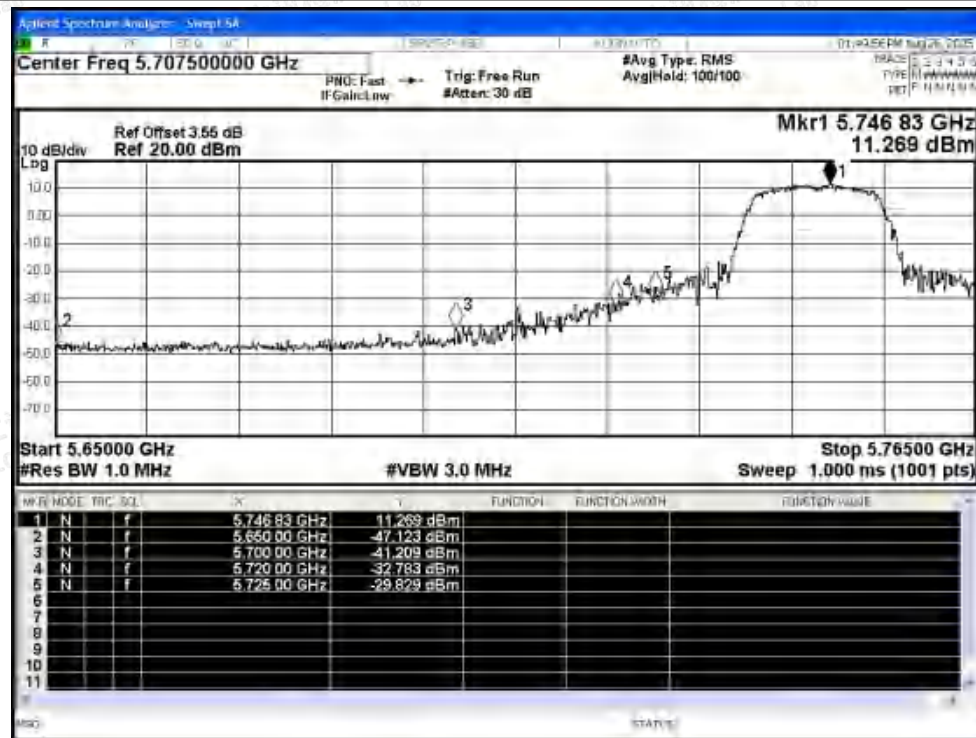

Restrict Band NVNT a 5745MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant2 Peak

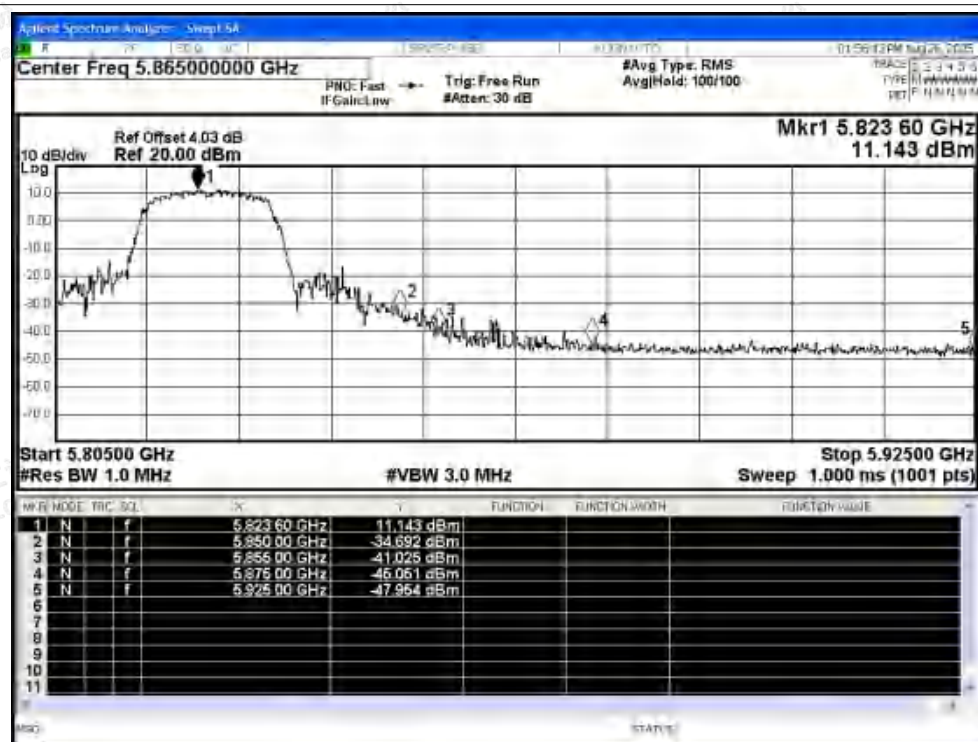


Restrict Band NVNT a 5825MHz Ant2 Average

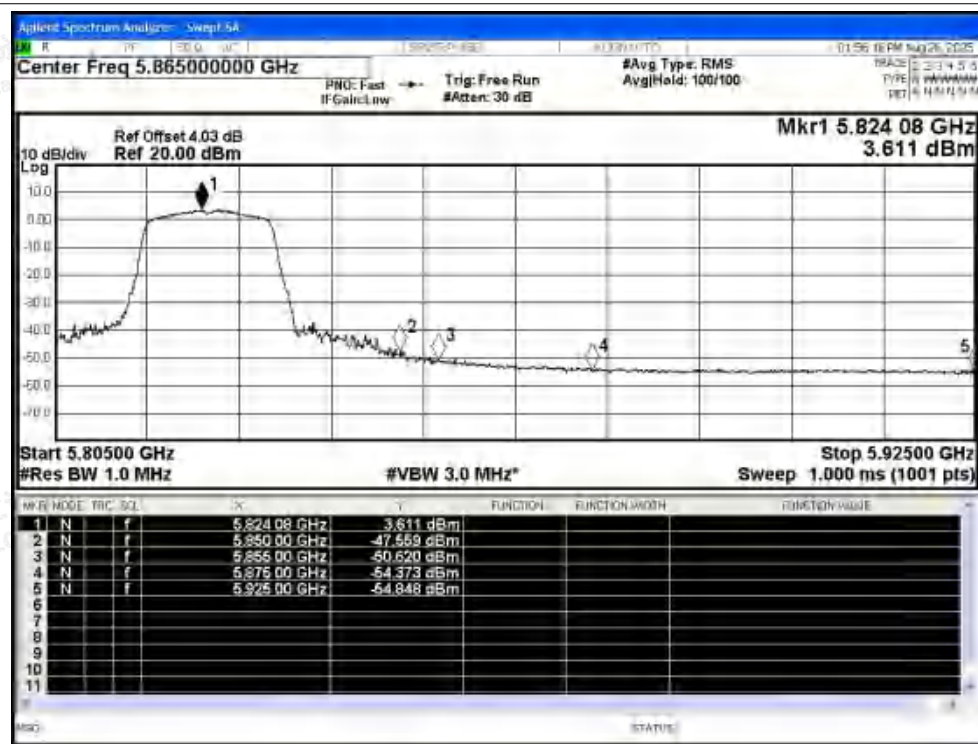



Restrict Band NVNT n20 5745MHz Ant2 Peak

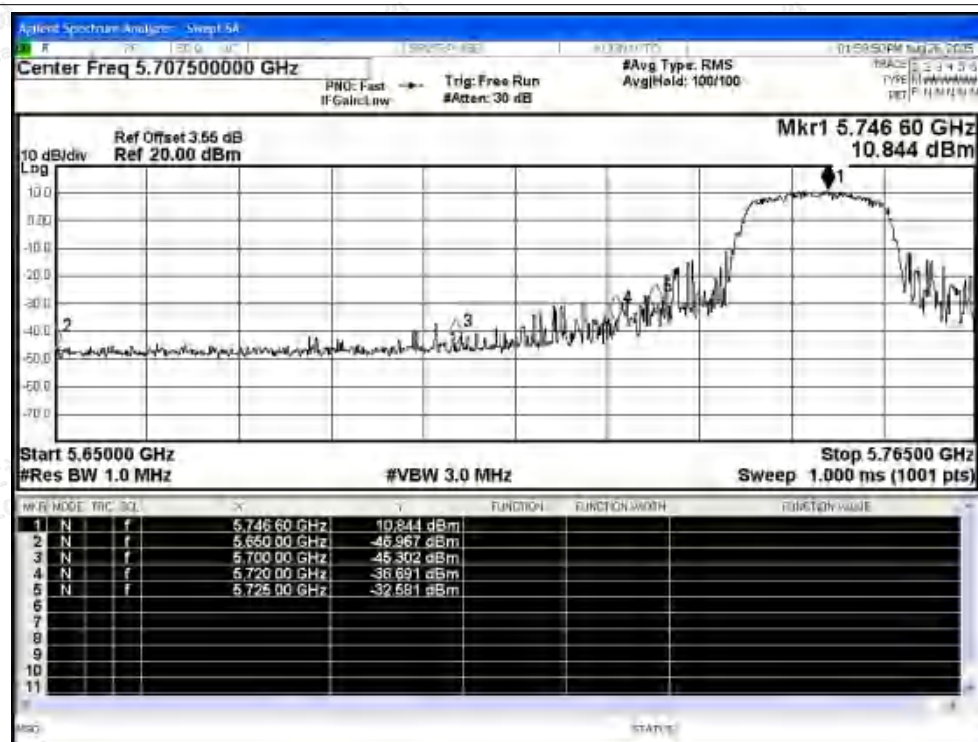

Restrict Band NVNT n20 5745MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant2 Peak

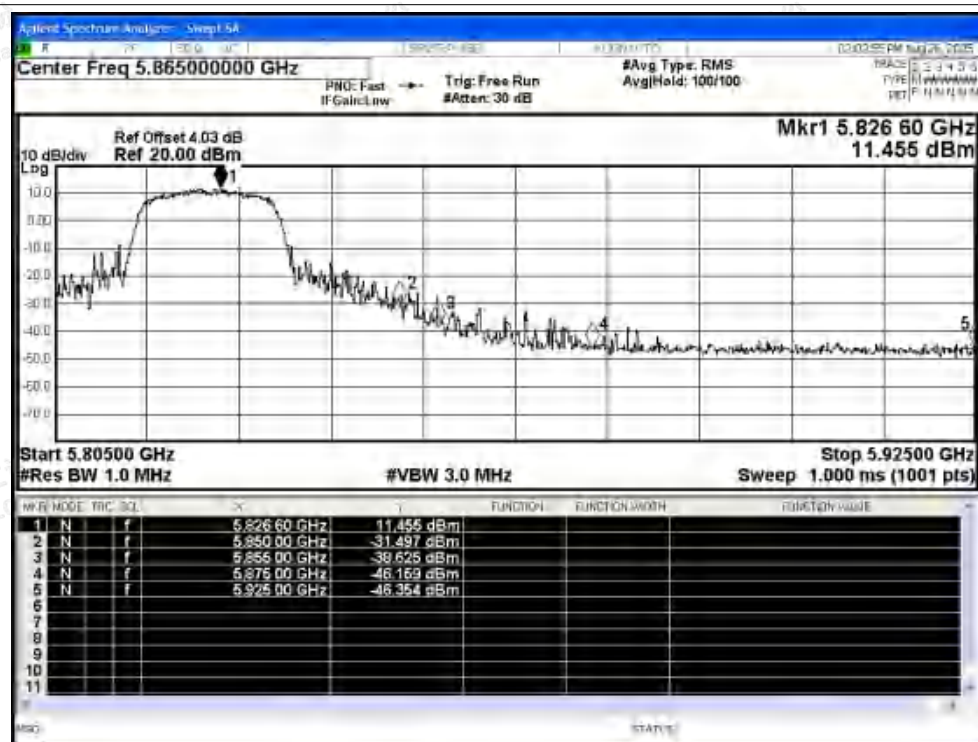

Restrict Band NVNT n20 5825MHz Ant2 Average

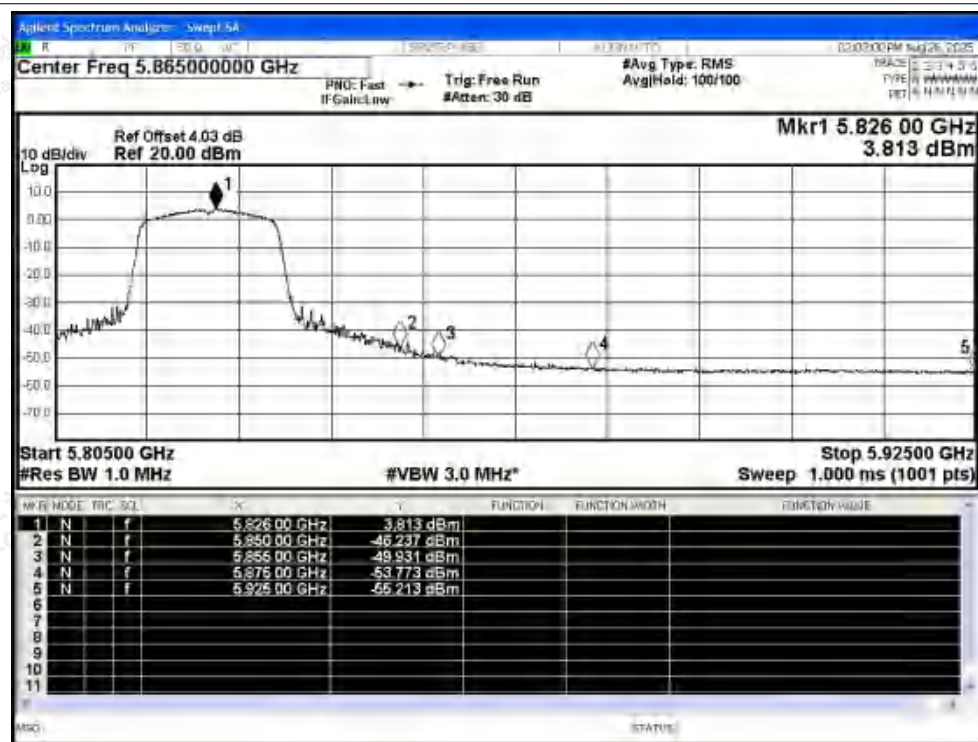




Restrict Band NVNT n40 5755MHz Ant2 Peak



Restrict Band NVNT n40 5755MHz Ant2 Average

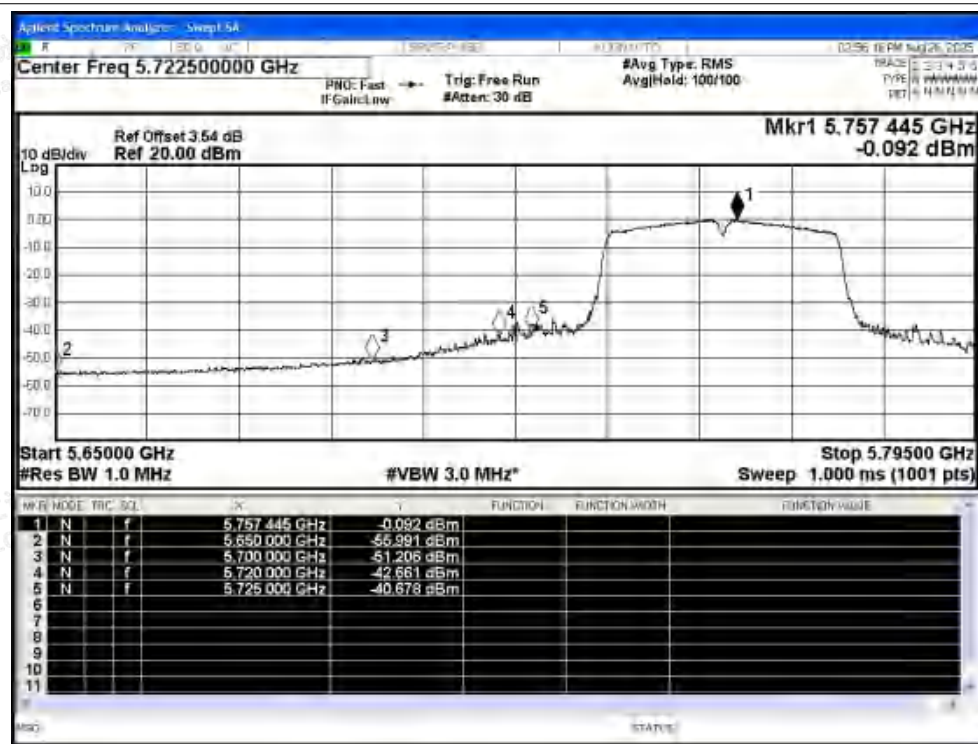

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant2 Peak

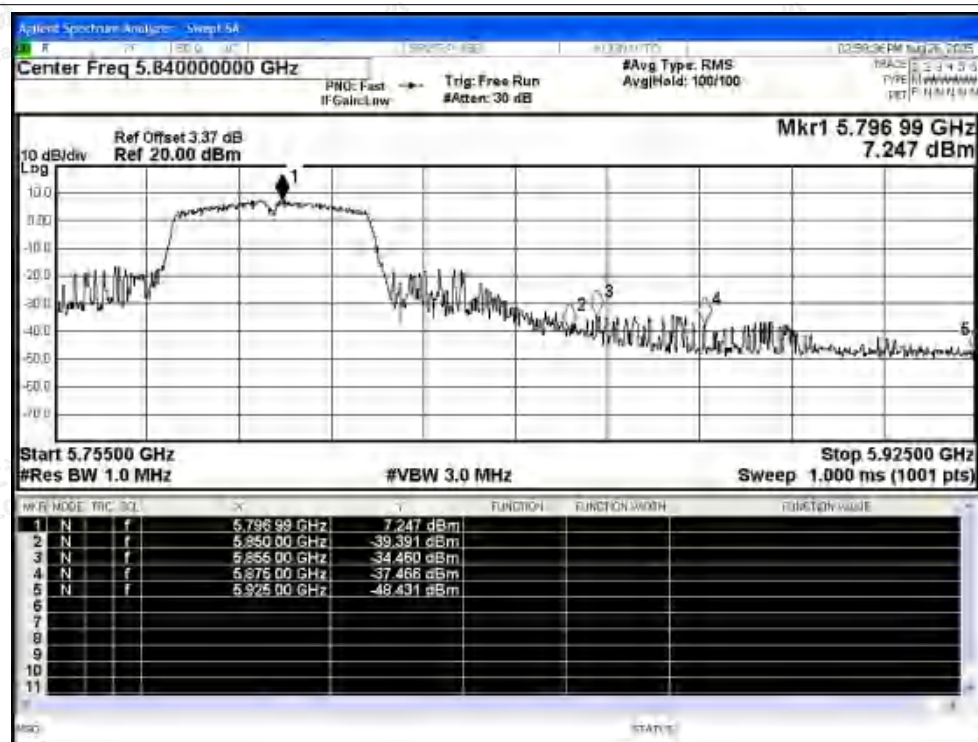

Restrict Band NVNT n40 5795MHz Ant2 Average

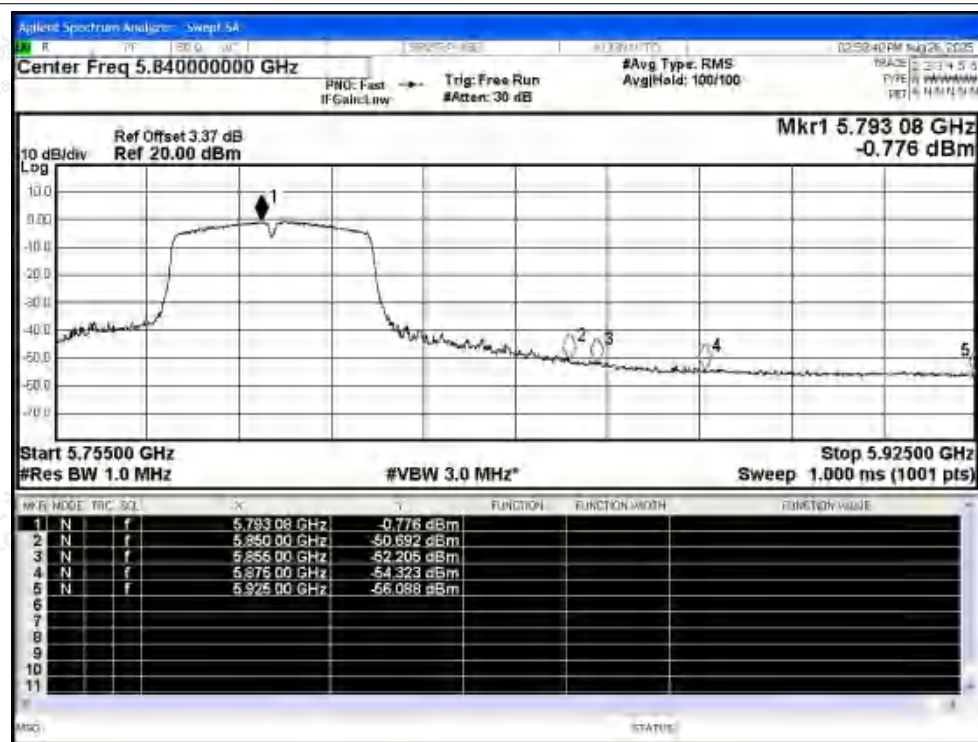

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant2 Peak

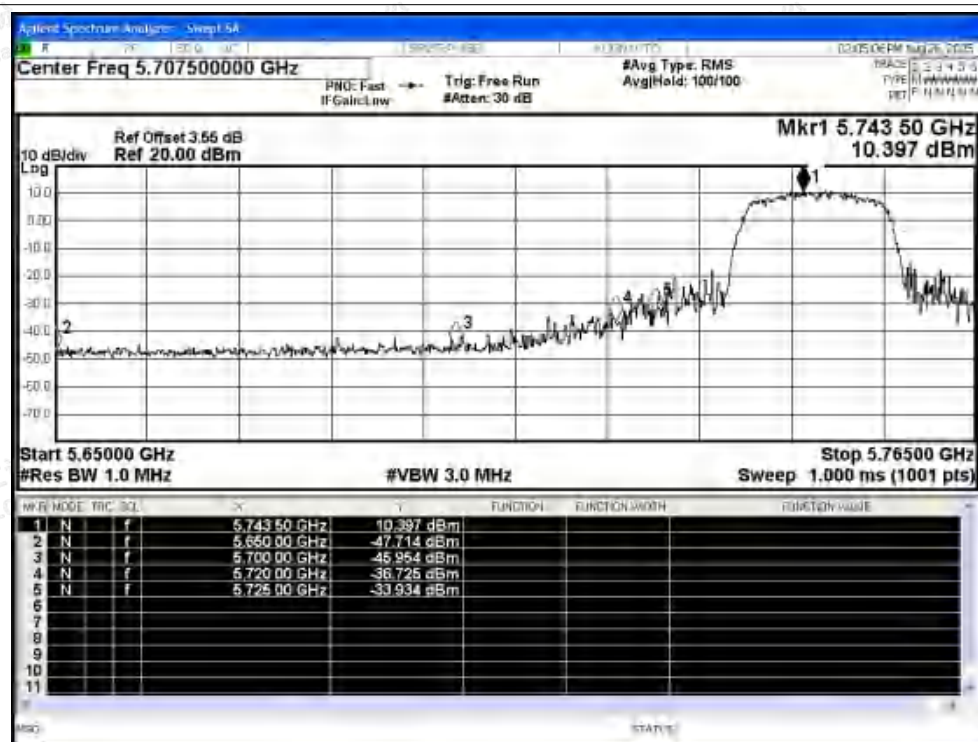

Restrict Band NVNT ac20 5745MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant2 Peak

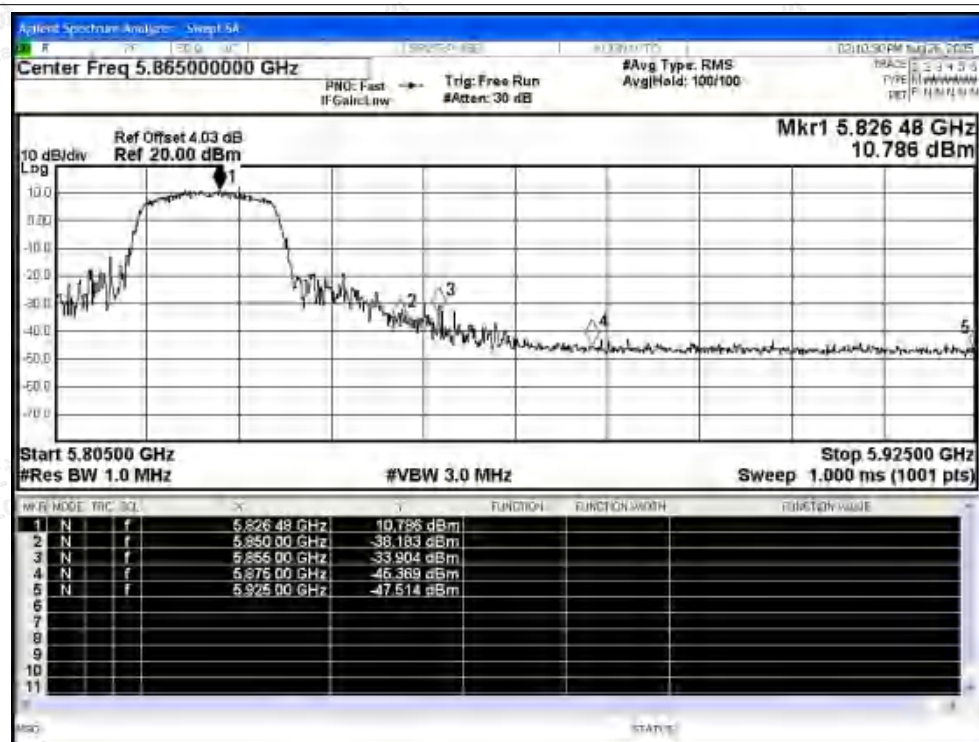

Restrict Band NVNT ac20 5825MHz Ant2 Average

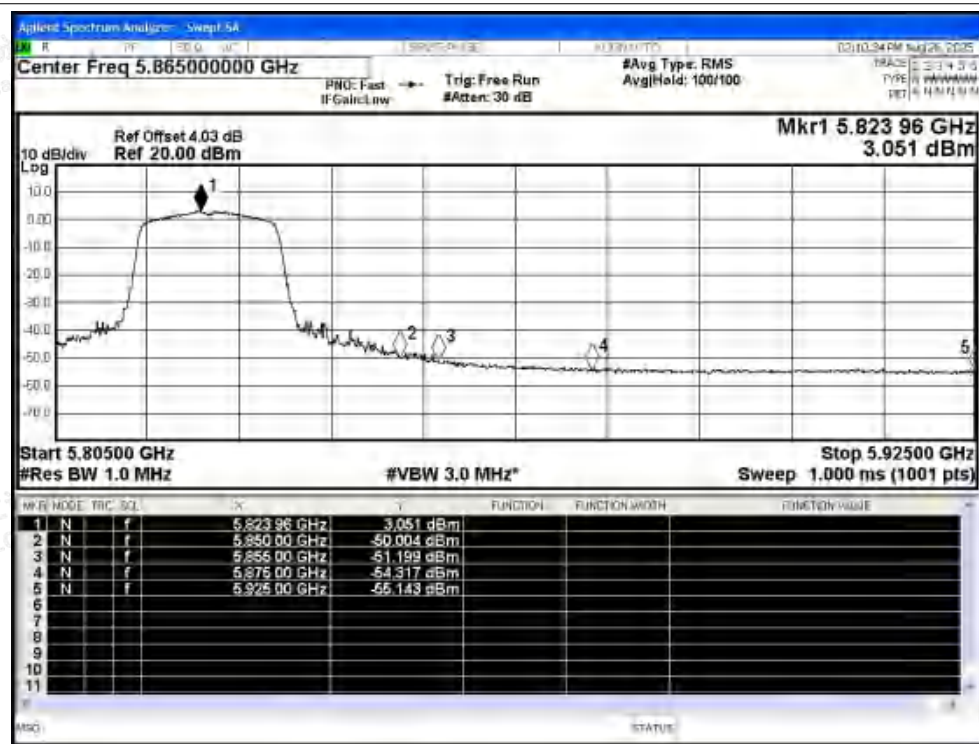


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant2 Peak

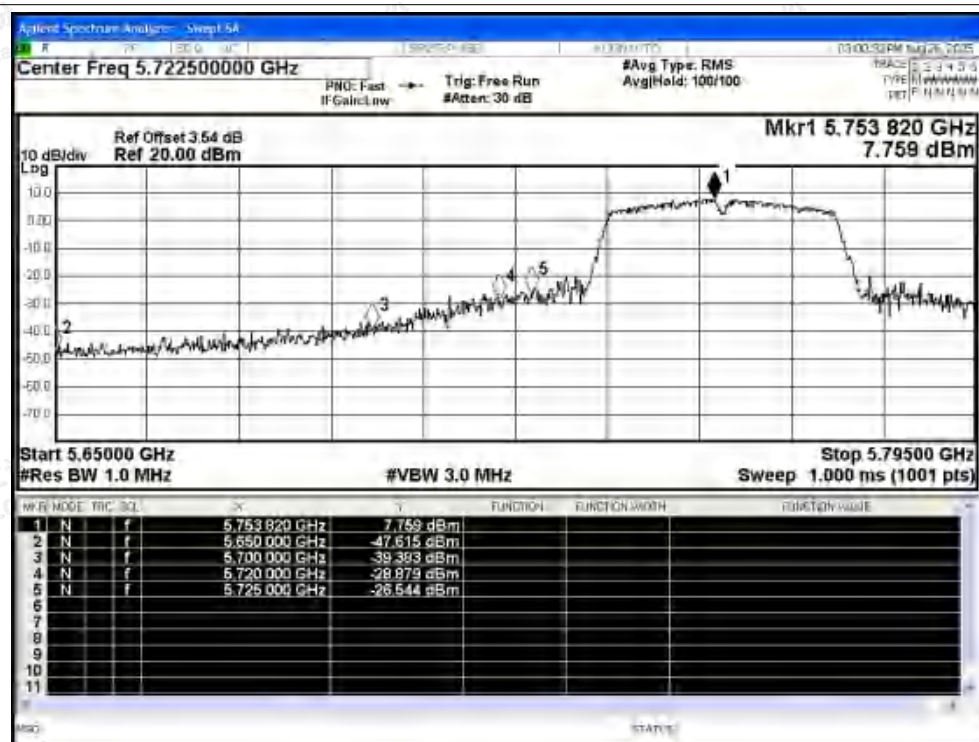

Restrict Band NVNT ac40 5755MHz Ant2 Average

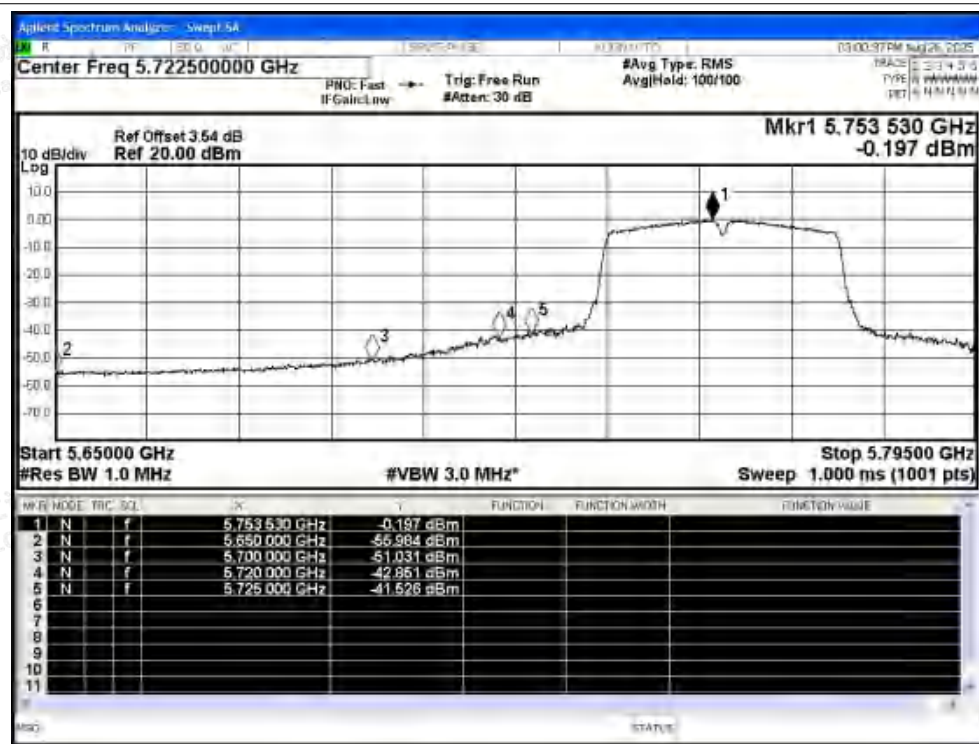


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant2 Peak



Restrict Band NVNT ac40 5795MHz Ant2 Average

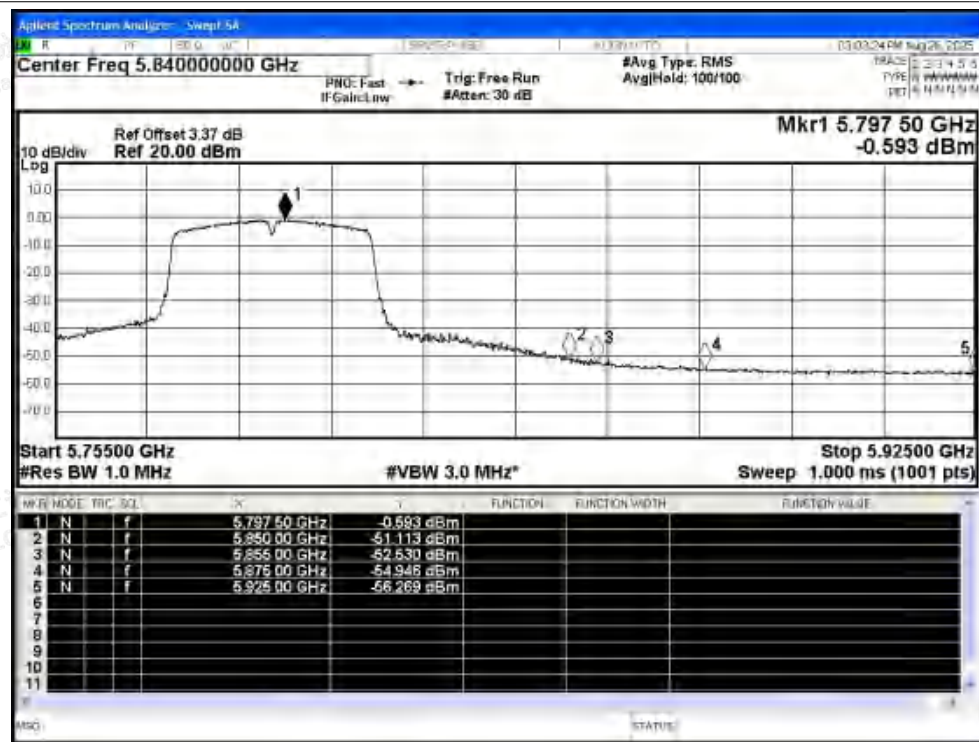

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant2 Peak

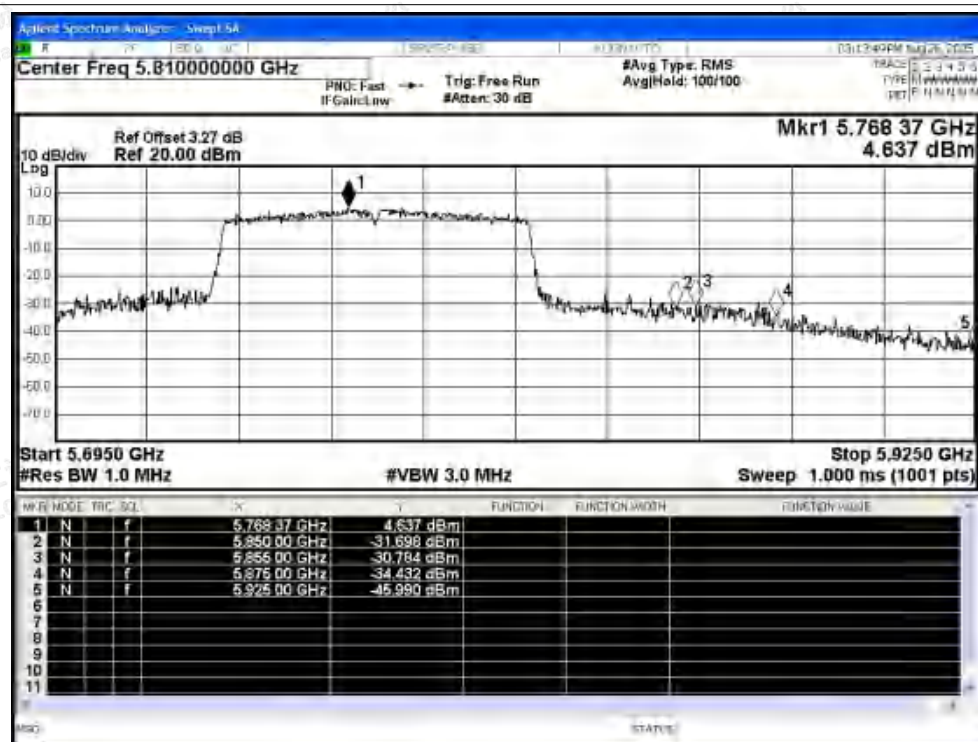

Restrict Band NVNT ac80 5775MHz Ant2 Average

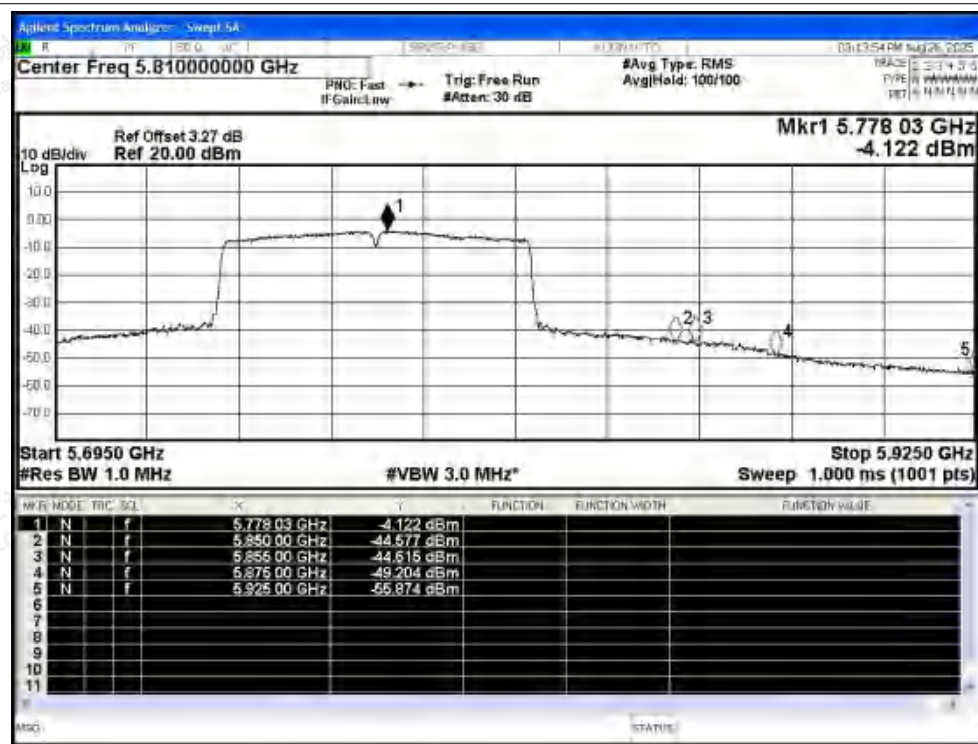

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant2 Peak

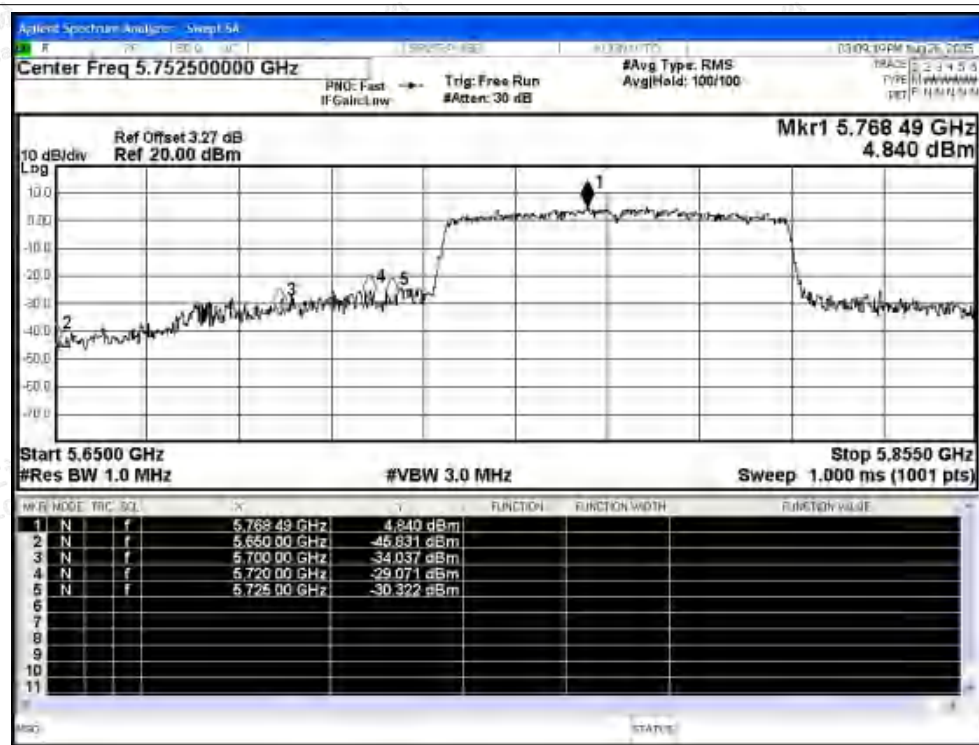

Restrict Band NVNT ac80 5775MHz Ant2 Average

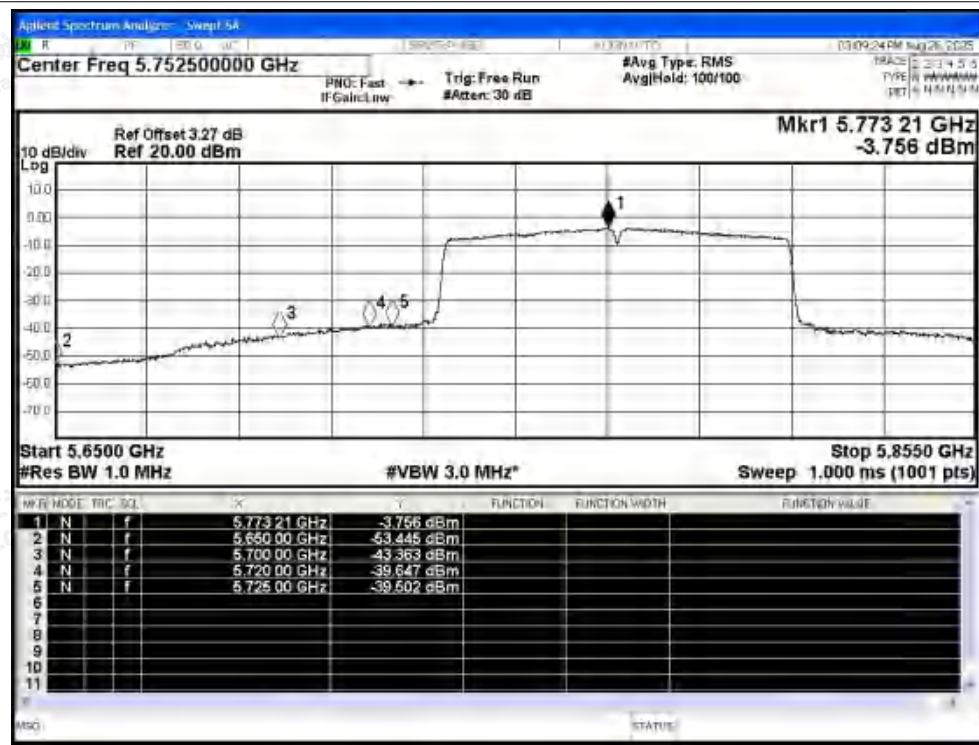

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant2 Peak



Restrict Band NVNT ax20 5745MHz Ant2 Average

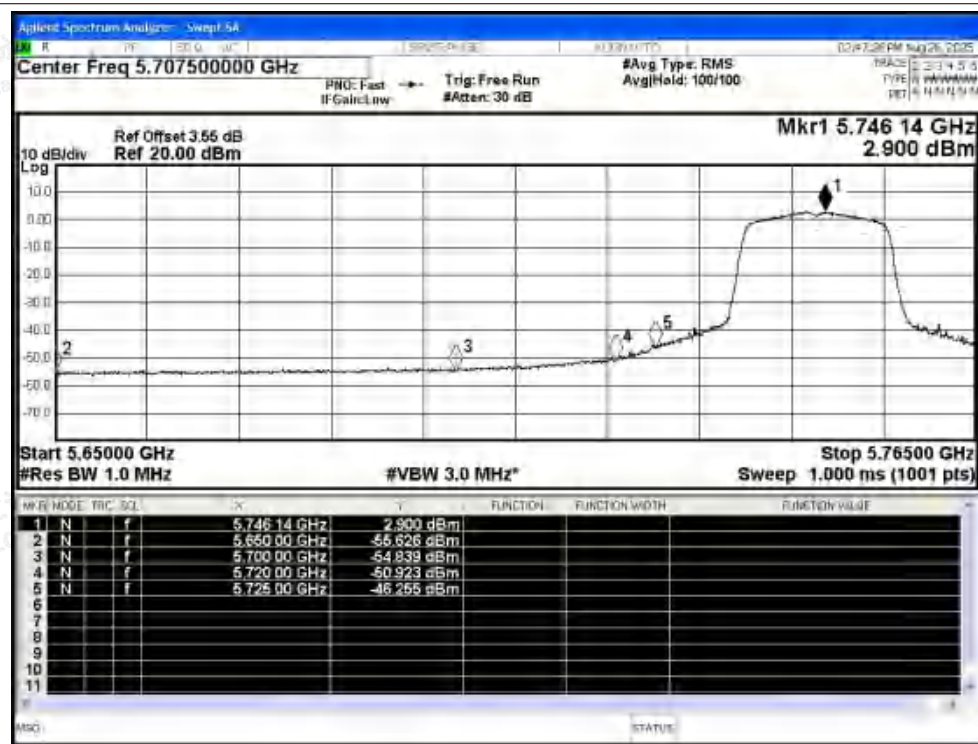

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant2 Peak

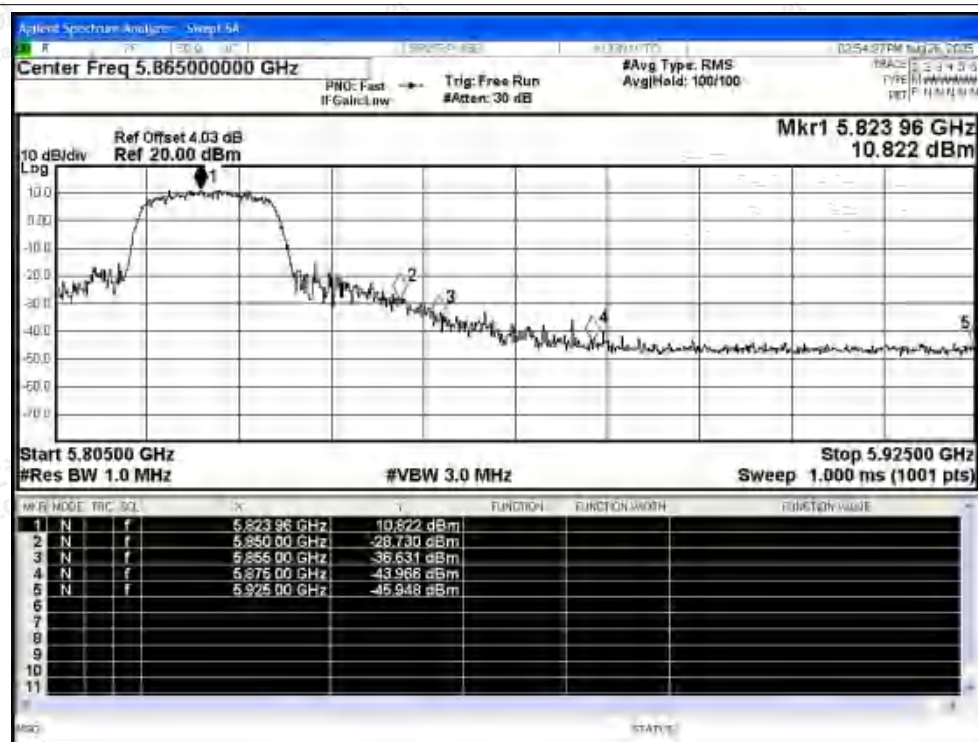

Restrict Band NVNT ax20 5825MHz Ant2 Average

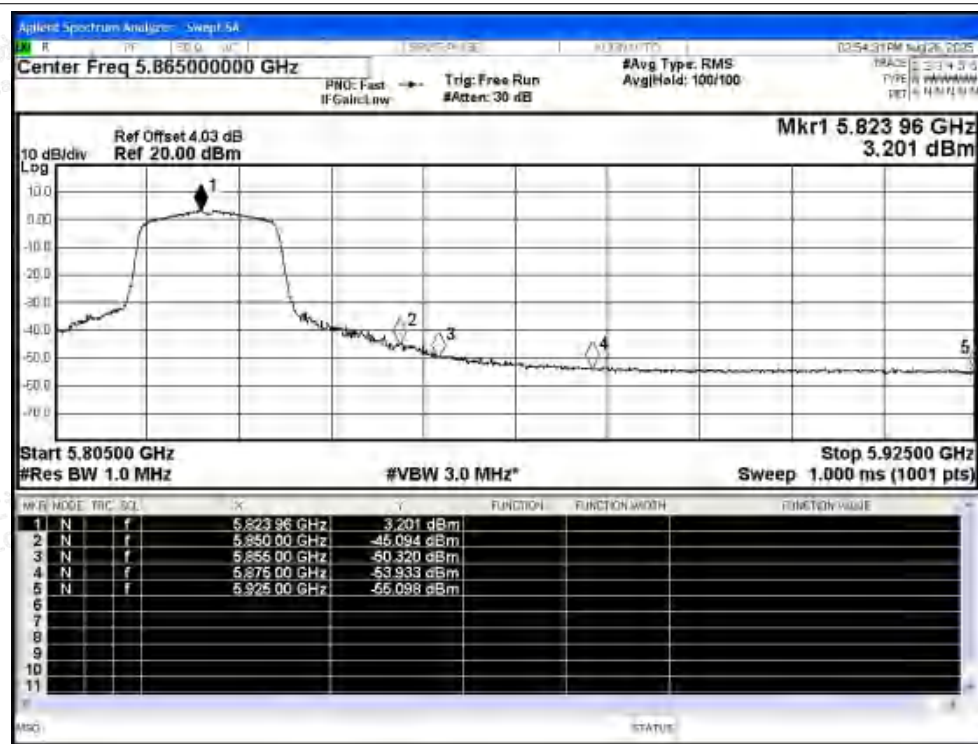

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant2 Peak



Restrict Band NVNT ax40 5755MHz Ant2 Average

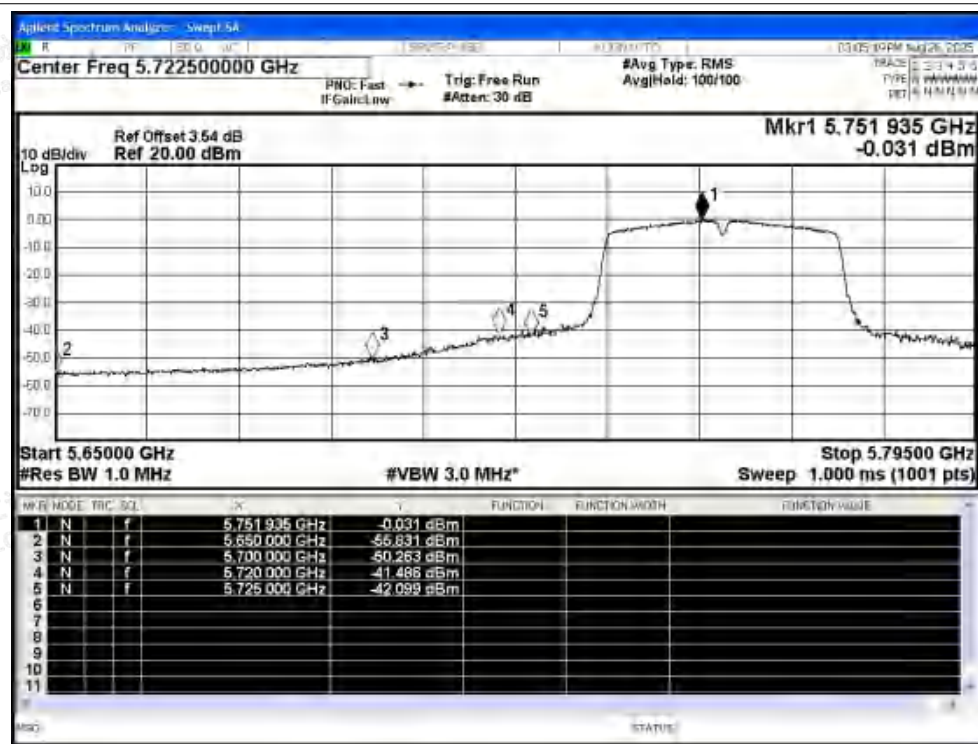

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant2 Peak

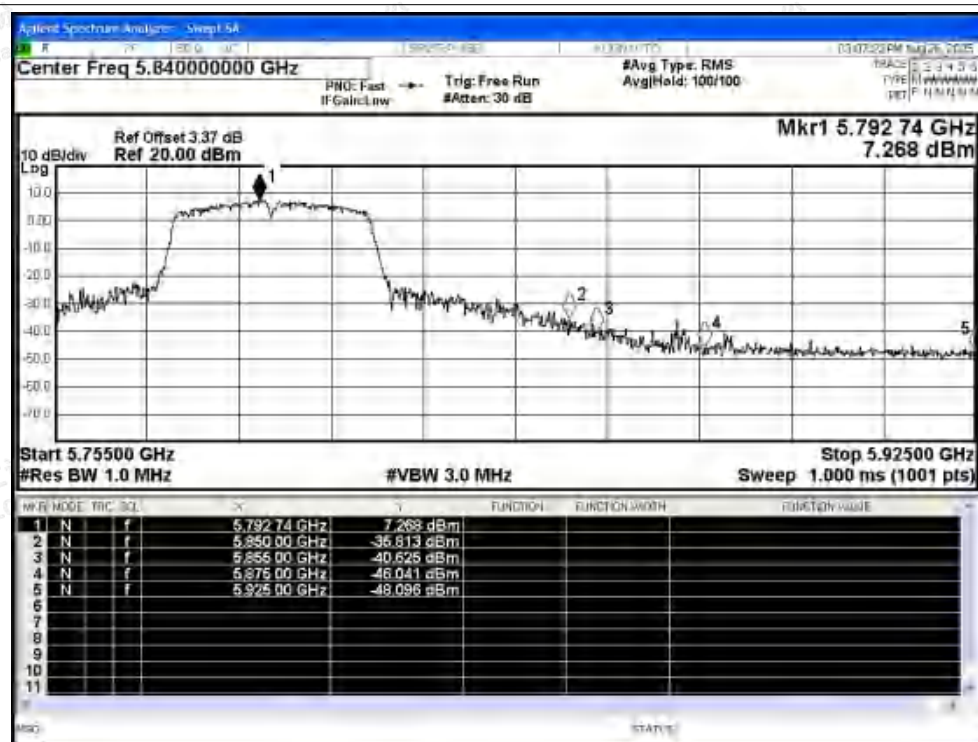

Restrict Band NVNT ax40 5795MHz Ant2 Average

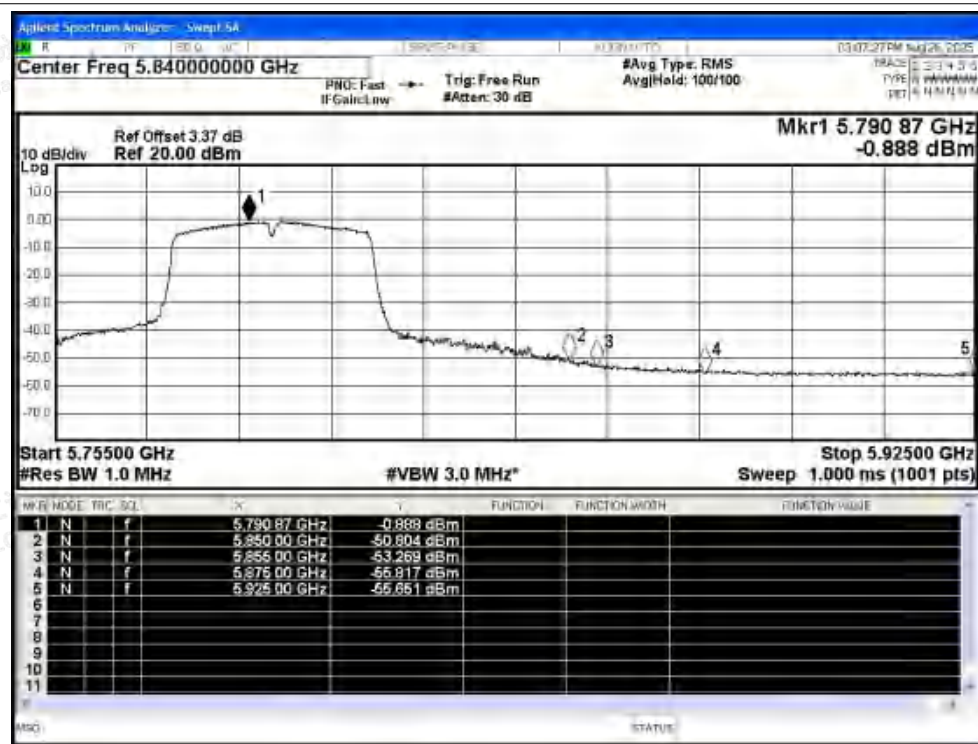

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant2 Peak

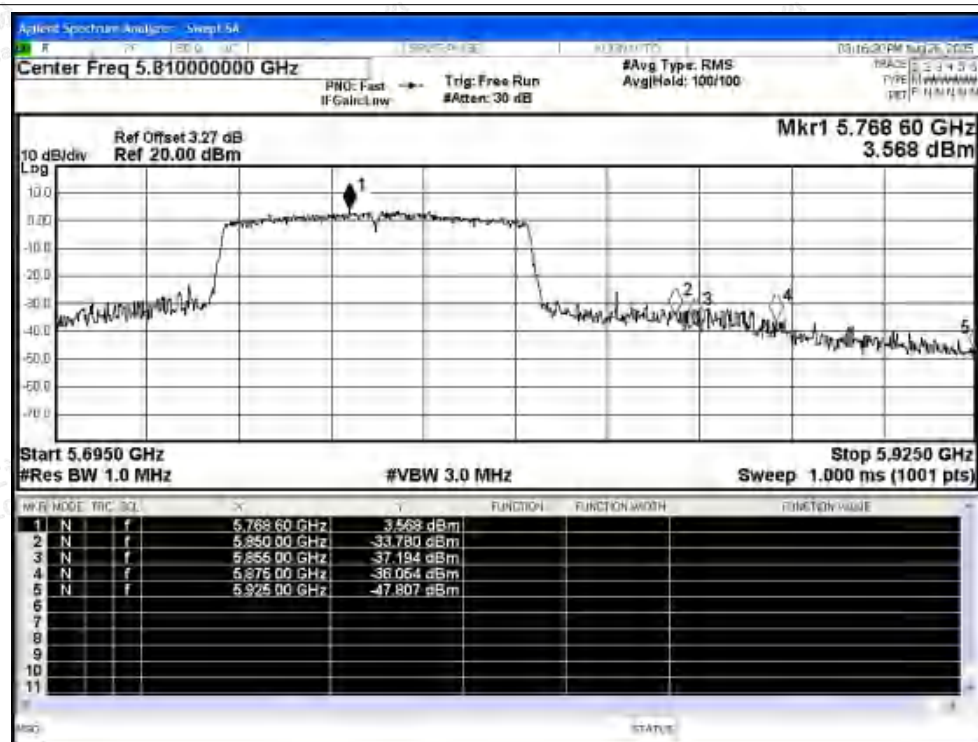

Restrict Band NVNT ax80 5775MHz Ant2 Average

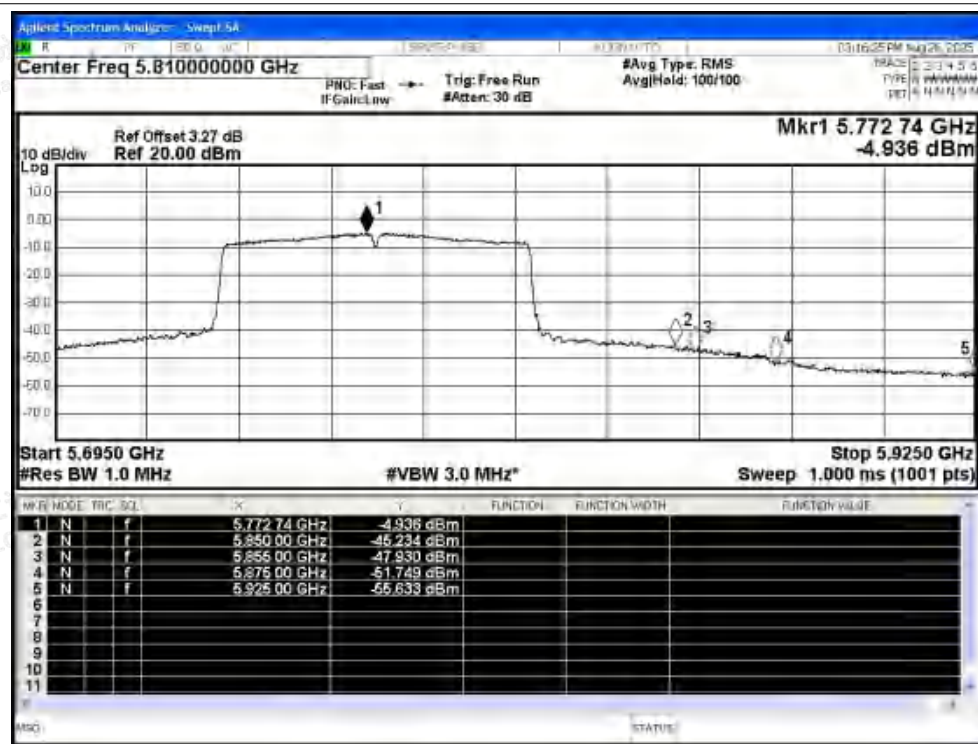

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant2 Peak

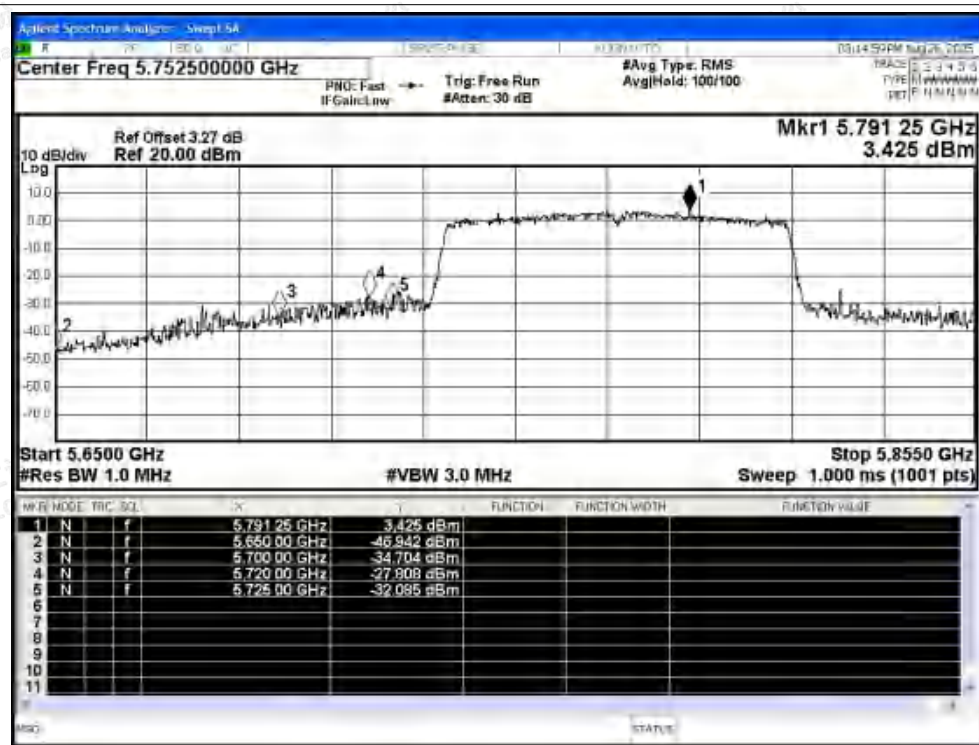

Restrict Band NVNT ax80 5775MHz Ant2 Average

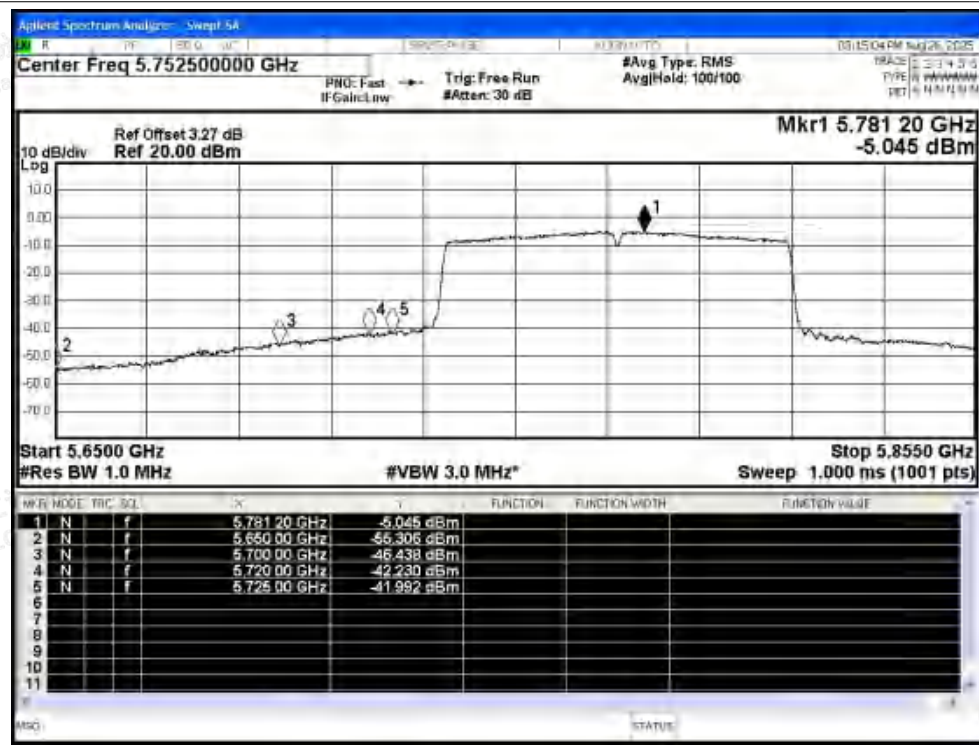


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Gain (dBi)	EIRP Power (dBm)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5745	-49.01	-46.97	8.03	-36.83	Peak	-27	Pass
NVNT	n20	5745	-56.72	-56.18	8.03	-45.4	Average	-27	Pass
NVNT	n20	5745	-42.37	-45.3	8.03	-32.55	Peak	10	Pass
NVNT	n20	5745	-53.64	-54.69	8.03	-43.09	Average	10	Pass
NVNT	n20	5745	-31.89	-36.69	8.03	-22.62	Peak	15.6	Pass
NVNT	n20	5745	-47.81	-51.13	8.03	-38.12	Average	15.6	Pass
NVNT	n20	5745	-26.94	-32.58	8.03	-17.86	Peak	27	Pass
NVNT	n20	5745	-42.22	-43.48	8.03	-31.76	Average	27	Pass
NVNT	n20	5825	-30.3	-31.5	8.03	-19.82	Peak	27	Pass
NVNT	n20	5825	-45.11	-46.24	8.03	-34.6	Average	27	Pass
NVNT	n20	5825	-36.22	-38.63	8.03	-26.22	Peak	15.6	Pass
NVNT	n20	5825	-49.22	-49.93	8.03	-38.52	Average	15.6	Pass
NVNT	n20	5825	-45.8	-46.16	8.03	-34.94	Peak	10	Pass
NVNT	n20	5825	-53.3	-53.77	8.03	-42.49	Average	10	Pass
NVNT	n20	5825	-47.07	-46.35	8.03	-35.65	Peak	-27	Pass
NVNT	n20	5825	-55.46	-55.21	8.03	-44.29	Average	-27	Pass
NVNT	n40	5755	-45.61	-45.94	8.03	-34.73	Peak	-27	Pass
NVNT	n40	5755	-56.08	-55.99	8.03	-44.99	Average	-27	Pass
NVNT	n40	5755	-42.84	-37.02	8.03	-27.98	Peak	10	Pass
NVNT	n40	5755	-51.71	-51.21	8.03	-40.41	Average	10	Pass
NVNT	n40	5755	-19.14	-26.71	8.03	-10.41	Peak	15.6	Pass
NVNT	n40	5755	-41.37	-42.66	8.03	-30.93	Average	15.6	Pass
NVNT	n40	5755	-17.15	-28.07	8.03	-8.78	Peak	27	Pass
NVNT	n40	5755	-41.17	-40.68	8.03	-29.88	Average	27	Pass
NVNT	n40	5795	-38.05	-39.39	8.03	-27.63	Peak	27	Pass
NVNT	n40	5795	-51.31	-50.69	8.03	-39.95	Average	27	Pass
NVNT	n40	5795	-33.09	-34.46	8.03	-22.68	Peak	15.6	Pass
NVNT	n40	5795	-52.16	-52.21	8.03	-41.14	Average	15.6	Pass
NVNT	n40	5795	-47.97	-37.47	8.03	-29.07	Peak	10	Pass
NVNT	n40	5795	-55.49	-54.32	8.03	-43.83	Average	10	Pass
NVNT	n40	5795	-47.58	-48.43	8.03	-36.94	Peak	-27	Pass
NVNT	n40	5795	-56.55	-56.09	8.03	-45.27	Average	-27	Pass
NVNT	ac20	5745	-48.71	-47.71	8.03	-37.14	Peak	-27	Pass
NVNT	ac20	5745	-56.2	-56.24	8.03	-45.18	Average	-27	Pass
NVNT	ac20	5745	-43.51	-45.95	8.03	-33.52	Peak	10	Pass
NVNT	ac20	5745	-54.98	-54.01	8.03	-43.43	Average	10	Pass
NVNT	ac20	5745	-37.46	-36.73	8.03	-26.04	Peak	15.6	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5745	-50.48	-50.35	8.03	-39.37	Average	15.6	Pass
NVNT	ac20	5745	-31.81	-33.93	8.03	-21.7	Peak	27	Pass
NVNT	ac20	5745	-47.22	-46.69	8.03	-35.91	Average	27	Pass
NVNT	ac20	5825	-37.66	-38.18	8.03	-26.87	Peak	27	Pass
NVNT	ac20	5825	-49.69	-50	8.03	-38.8	Average	27	Pass
NVNT	ac20	5825	-39.36	-33.9	8.03	-24.78	Peak	15.6	Pass
NVNT	ac20	5825	-52.33	-51.2	8.03	-40.69	Average	15.6	Pass
NVNT	ac20	5825	-47.1	-45.37	8.03	-35.11	Peak	10	Pass
NVNT	ac20	5825	-54.92	-54.32	8.03	-43.57	Average	10	Pass
NVNT	ac20	5825	-47.57	-47.51	8.03	-36.5	Peak	-27	Pass
NVNT	ac20	5825	-55.88	-55.14	8.03	-44.45	Average	-27	Pass
NVNT	ac40	5755	-49.22	-47.62	8.03	-37.31	Peak	-27	Pass
NVNT	ac40	5755	-54.95	-55.98	8.03	-44.39	Average	-27	Pass
NVNT	ac40	5755	-40.73	-39.38	8.03	-28.96	Peak	10	Pass
NVNT	ac40	5755	-51.57	-51.03	8.03	-40.25	Average	10	Pass
NVNT	ac40	5755	-28.86	-28.88	8.03	-17.83	Peak	15.6	Pass
NVNT	ac40	5755	-42.14	-42.85	8.03	-31.44	Average	15.6	Pass
NVNT	ac40	5755	-31.33	-26.54	8.03	-17.27	Peak	27	Pass
NVNT	ac40	5755	-41.31	-41.53	8.03	-30.38	Average	27	Pass
NVNT	ac40	5795	-35.42	-37.62	8.03	-25.34	Peak	27	Pass
NVNT	ac40	5795	-50.05	-51.11	8.03	-39.51	Average	27	Pass
NVNT	ac40	5795	-40.23	-39.38	8.03	-28.74	Peak	15.6	Pass
NVNT	ac40	5795	-52.04	-52.53	8.03	-41.24	Average	15.6	Pass
NVNT	ac40	5795	-41.08	-43.83	8.03	-31.2	Peak	10	Pass
NVNT	ac40	5795	-54.62	-54.95	8.03	-43.74	Average	10	Pass
NVNT	ac40	5795	-49.12	-48.77	8.03	-37.9	Peak	-27	Pass
NVNT	ac40	5795	-56.06	-56.27	8.03	-45.12	Average	-27	Pass
NVNT	ac80	5775	-30.54	-31.7	8.03	-20.04	Peak	27	Pass
NVNT	ac80	5775	-43.62	-44.58	8.03	-33.03	Average	27	Pass
NVNT	ac80	5775	-34.05	-30.78	8.03	-21.07	Peak	15.6	Pass
NVNT	ac80	5775	-44.39	-44.62	8.03	-33.46	Average	15.6	Pass
NVNT	ac80	5775	-37.07	-34.43	8.03	-24.51	Peak	10	Pass
NVNT	ac80	5775	-47.91	-49.2	8.03	-37.47	Average	10	Pass
NVNT	ac80	5775	-43.88	-45.99	8.03	-33.77	Peak	-27	Pass
NVNT	ac80	5775	-55.48	-55.87	8.03	-44.63	Average	-27	Pass
NVNT	ac80	5775	-43.67	-45.83	8.03	-33.58	Peak	-27	Pass
NVNT	ac80	5775	-53.98	-53.45	8.03	-42.67	Average	-27	Pass
NVNT	ac80	5775	-31.55	-34.04	8.03	-21.58	Peak	10	Pass
NVNT	ac80	5775	-44.06	-43.36	8.03	-32.66	Average	10	Pass
NVNT	ac80	5775	-30.89	-29.07	8.03	-18.84	Peak	15.6	Pass
NVNT	ac80	5775	-39.82	-39.65	8.03	-28.69	Average	15.6	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	-31.58	-30.32	8.03	-19.86	Peak	27	Pass
NVNT	ac80	5775	-40.5	-39.5	8.03	-28.93	Average	27	Pass
NVNT	ax20	5745	-47.4	-48.34	8.03	-36.8	Peak	-27	Pass
NVNT	ax20	5745	-55.86	-55.63	8.03	-44.7	Average	-27	Pass
NVNT	ax20	5745	-44.22	-45.34	8.03	-33.7	Peak	10	Pass
NVNT	ax20	5745	-54.58	-54.84	8.03	-43.67	Average	10	Pass
NVNT	ax20	5745	-35.37	-38.29	8.03	-25.55	Peak	15.6	Pass
NVNT	ax20	5745	-50.16	-50.92	8.03	-39.48	Average	15.6	Pass
NVNT	ax20	5745	-23.59	-36.8	8.03	-15.36	Peak	27	Pass
NVNT	ax20	5745	-46.2	-46.26	8.03	-35.19	Average	27	Pass
NVNT	ax20	5825	-35.62	-28.73	8.03	-19.89	Peak	27	Pass
NVNT	ax20	5825	-47.37	-45.09	8.03	-35.04	Average	27	Pass
NVNT	ax20	5825	-39.48	-36.63	8.03	-26.78	Peak	15.6	Pass
NVNT	ax20	5825	-51.77	-50.32	8.03	-39.94	Average	15.6	Pass
NVNT	ax20	5825	-45.13	-43.97	8.03	-33.47	Peak	10	Pass
NVNT	ax20	5825	-54.6	-53.93	8.03	-43.21	Average	10	Pass
NVNT	ax20	5825	-46.6	-45.95	8.03	-35.22	Peak	-27	Pass
NVNT	ax20	5825	-55.12	-55.1	8.03	-44.07	Average	-27	Pass
NVNT	ax40	5755	-47.35	-48.52	8.03	-36.86	Peak	-27	Pass
NVNT	ax40	5755	-55.62	-55.83	8.03	-44.68	Average	-27	Pass
NVNT	ax40	5755	-44.86	-39.02	8.03	-29.98	Peak	10	Pass
NVNT	ax40	5755	-52.34	-50.26	8.03	-40.14	Average	10	Pass
NVNT	ax40	5755	-30.39	-27.3	8.03	-17.54	Peak	15.6	Pass
NVNT	ax40	5755	-42.81	-41.49	8.03	-31.06	Average	15.6	Pass
NVNT	ax40	5755	-27.93	-25.74	8.03	-15.66	Peak	27	Pass
NVNT	ax40	5755	-42.04	-42.1	8.03	-31.03	Average	27	Pass
NVNT	ax40	5795	-41.75	-35.81	8.03	-26.79	Peak	27	Pass
NVNT	ax40	5795	-51.23	-50.8	8.03	-39.97	Average	27	Pass
NVNT	ax40	5795	-38.77	-40.63	8.03	-28.56	Peak	15.6	Pass
NVNT	ax40	5795	-52.92	-53.27	8.03	-42.05	Average	15.6	Pass
NVNT	ax40	5795	-47.13	-46.04	8.03	-35.51	Peak	10	Pass
NVNT	ax40	5795	-55.25	-55.82	8.03	-44.49	Average	10	Pass
NVNT	ax40	5795	-47.56	-48.1	8.03	-36.78	Peak	-27	Pass
NVNT	ax40	5795	-56.01	-55.65	8.03	-44.79	Average	-27	Pass
NVNT	ax80	5775	-31.78	-33.78	8.03	-21.63	Peak	27	Pass
NVNT	ax80	5775	-44.16	-45.23	8.03	-33.62	Average	27	Pass
NVNT	ax80	5775	-32.77	-37.19	8.03	-23.4	Peak	15.6	Pass
NVNT	ax80	5775	-45.14	-47.93	8.03	-35.27	Average	15.6	Pass
NVNT	ax80	5775	-35.54	-36.05	8.03	-24.75	Peak	10	Pass
NVNT	ax80	5775	-47.93	-51.75	8.03	-38.39	Average	10	Pass
NVNT	ax80	5775	-45.66	-47.81	8.03	-35.56	Peak	-27	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.




Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5775	-55.7	-55.63	8.03	-44.62	Average	-27	Pass
NVNT	ax80	5775	-46.07	-46.94	8.03	-35.44	Peak	-27	Pass
NVNT	ax80	5775	-54.48	-55.31	8.03	-43.83	Average	-27	Pass
NVNT	ax80	5775	-35.6	-34.7	8.03	-24.09	Peak	10	Pass
NVNT	ax80	5775	-44.31	-46.44	8.03	-34.21	Average	10	Pass
NVNT	ax80	5775	-27.69	-27.81	8.03	-16.71	Peak	15.6	Pass
NVNT	ax80	5775	-41.33	-42.23	8.03	-30.72	Average	15.6	Pass
NVNT	ax80	5775	-28.18	-32.09	8.03	-18.67	Peak	27	Pass
NVNT	ax80	5775	-40.62	-41.99	8.03	-30.21	Average	27	Pass

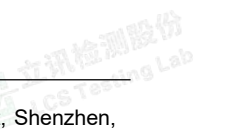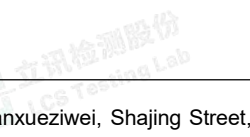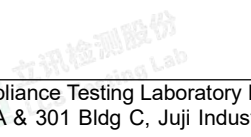


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant1	5744.96	-40000	-6.96	25	Pass
NVNT	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	n20	5745	Ant1	5745	0	0	25	Pass
NVNT	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
NVNT	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	n40	5755	Ant1	5755	0	0	25	Pass
NVNT	n40	5795	Ant1	5795	0	0	25	Pass
NVNT	ac20	5745	Ant1	5744.96	-40000	-6.96	25	Pass
NVNT	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	ac20	5825	Ant1	5825	0	0	25	Pass
NVNT	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant1	5795	0	0	25	Pass
NVNT	ac80	5775	Ant1	5775	0	0	25	Pass
NVNT	ax20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	ax20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	ax20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
NVNT	ax40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
NVNT	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant1	5775	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5745MHz Ant1

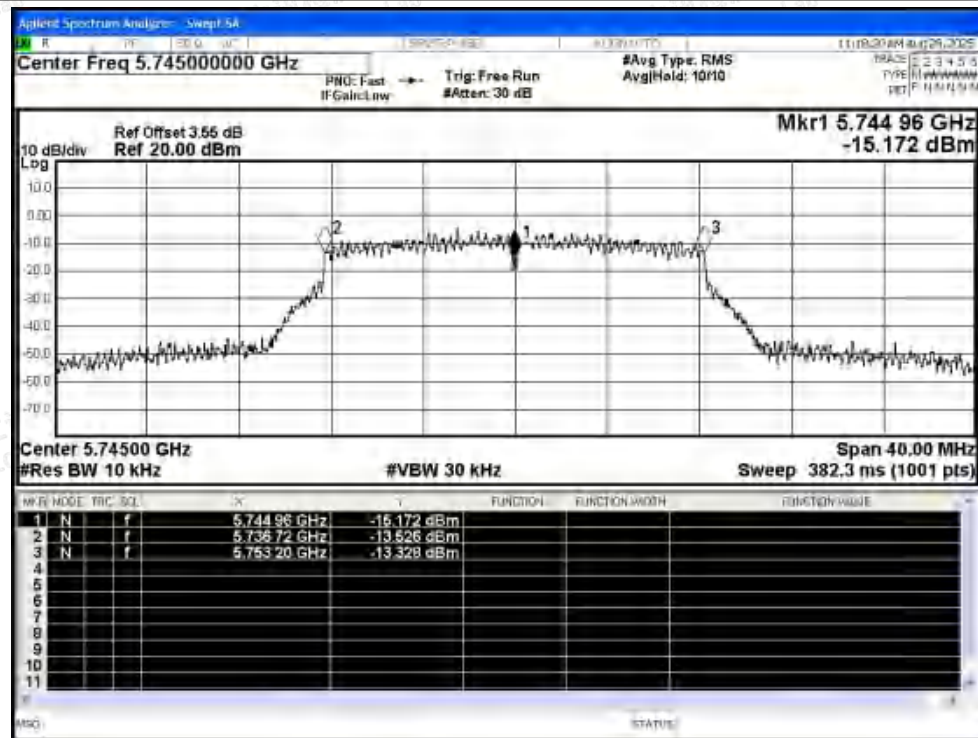

Freq. Stability NVNT a 5785MHz Ant1

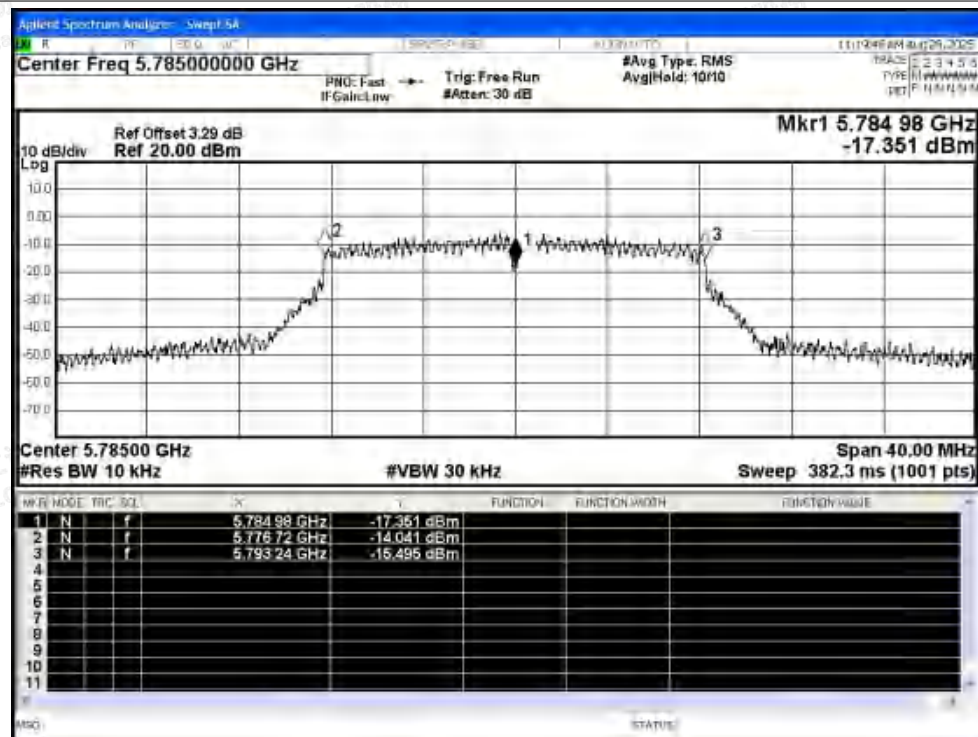

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant1

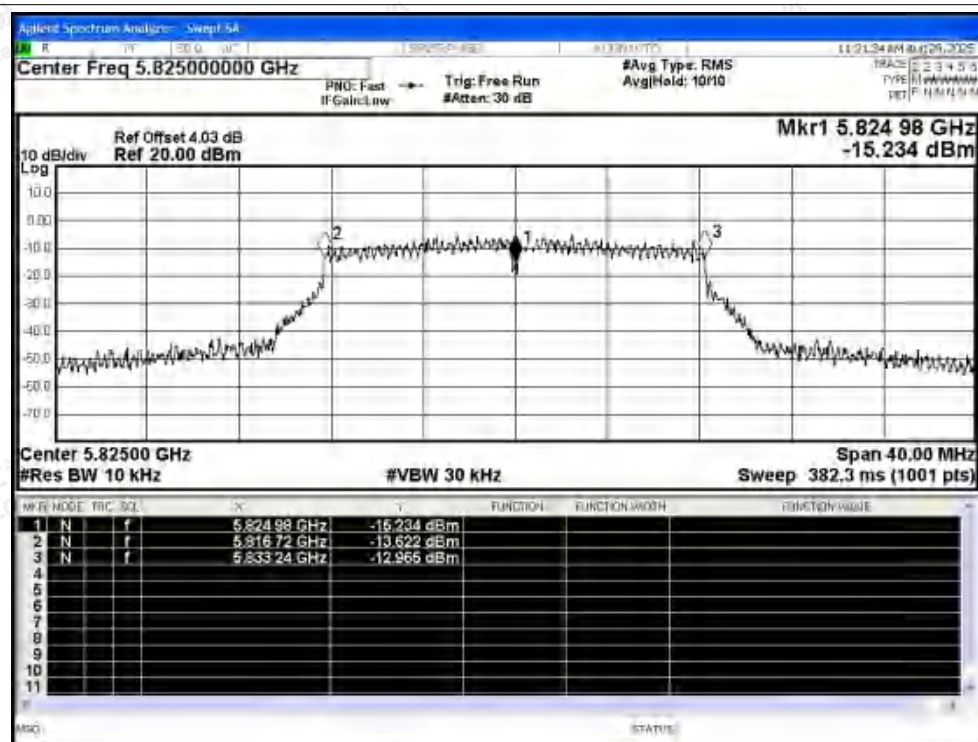


Freq. Stability NVNT n20 5745MHz Ant1

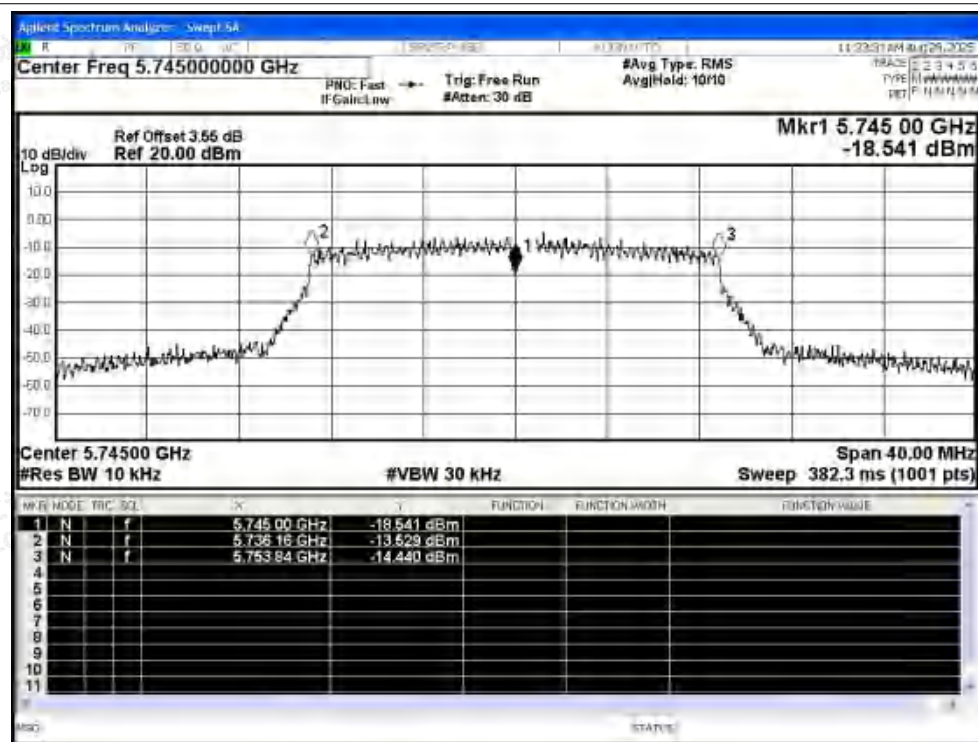




Freq. Stability NVNT n20 5785MHz Ant1

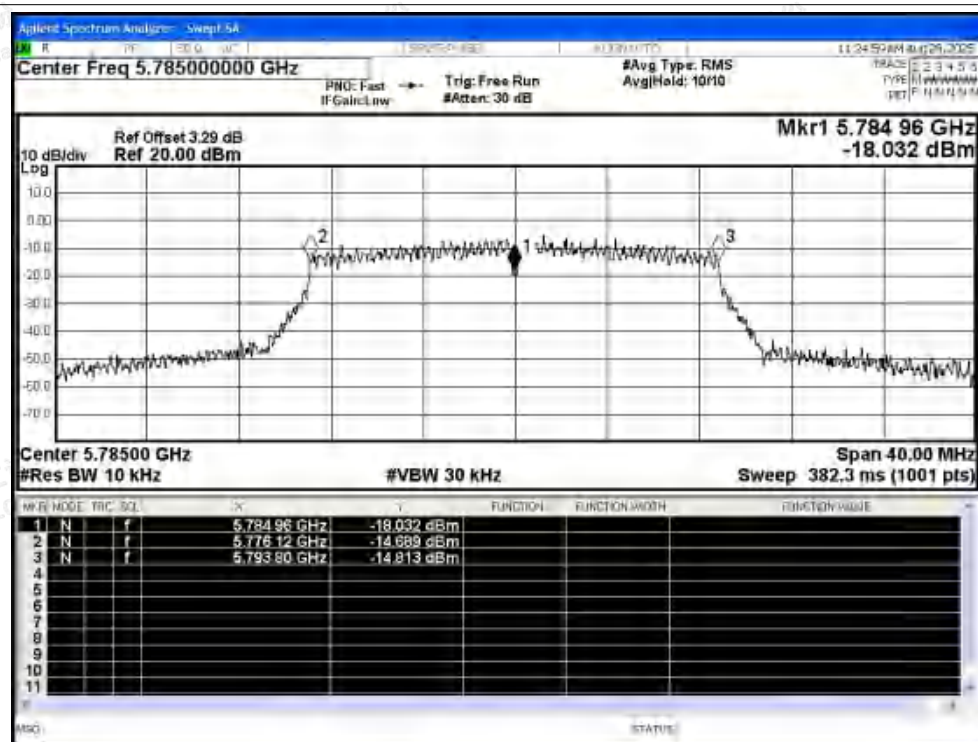


Freq. Stability NVNT n20 5825MHz Ant1

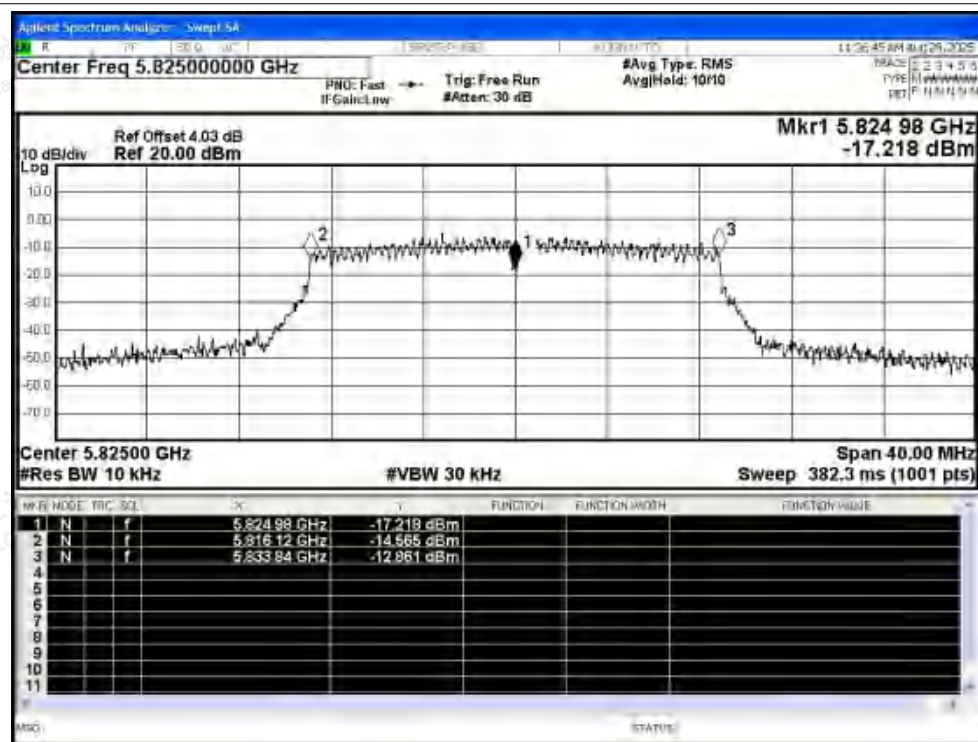




Freq. Stability NVNT n40 5755MHz Ant1

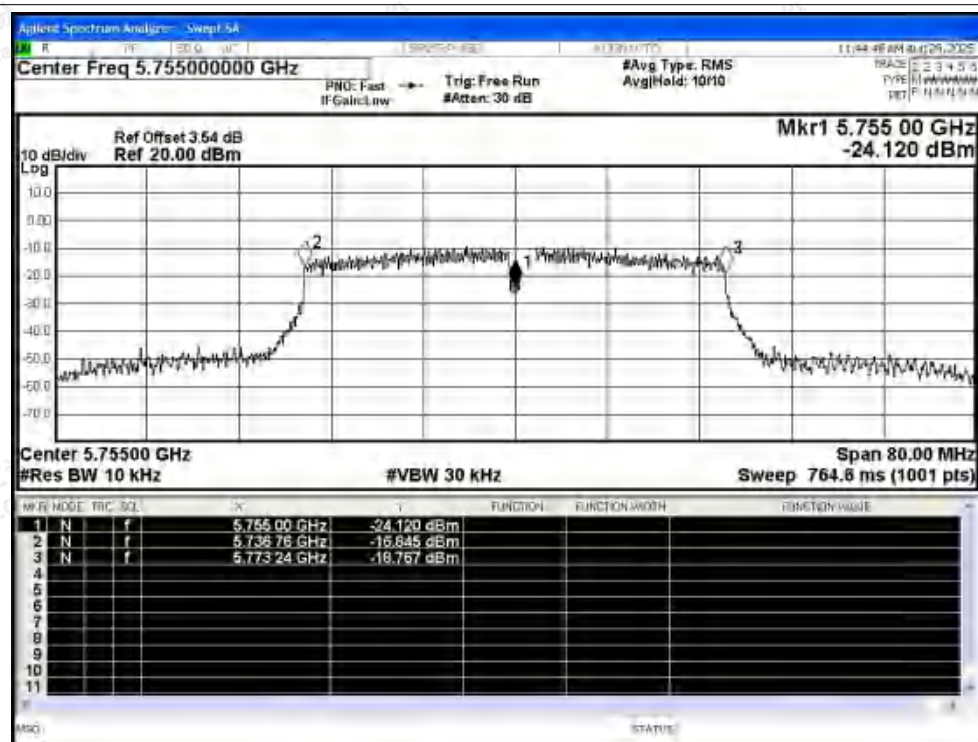


Freq. Stability NVNT n40 5795MHz Ant1

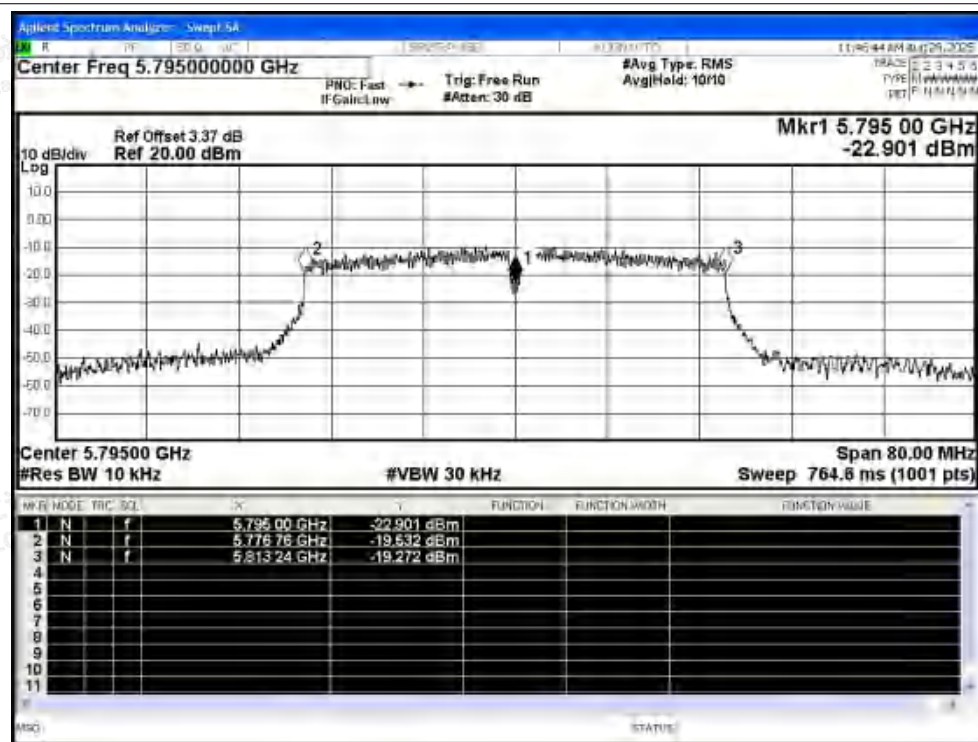




Freq. Stability NVNT ac20 5745MHz Ant1

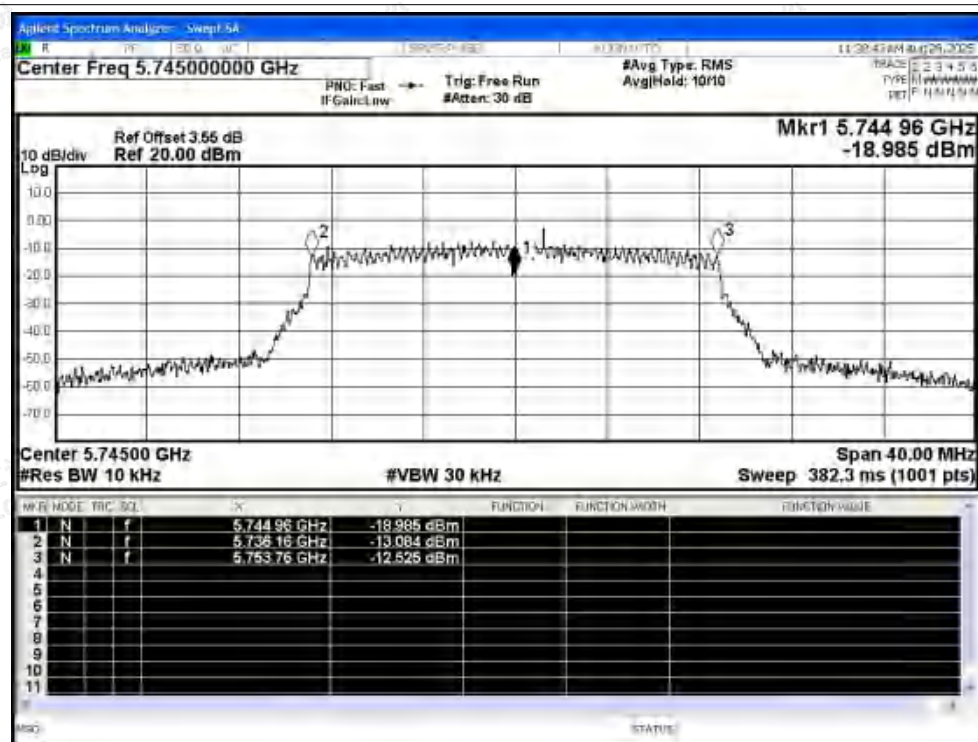

Freq. Stability NVNT ac20 5785MHz Ant1

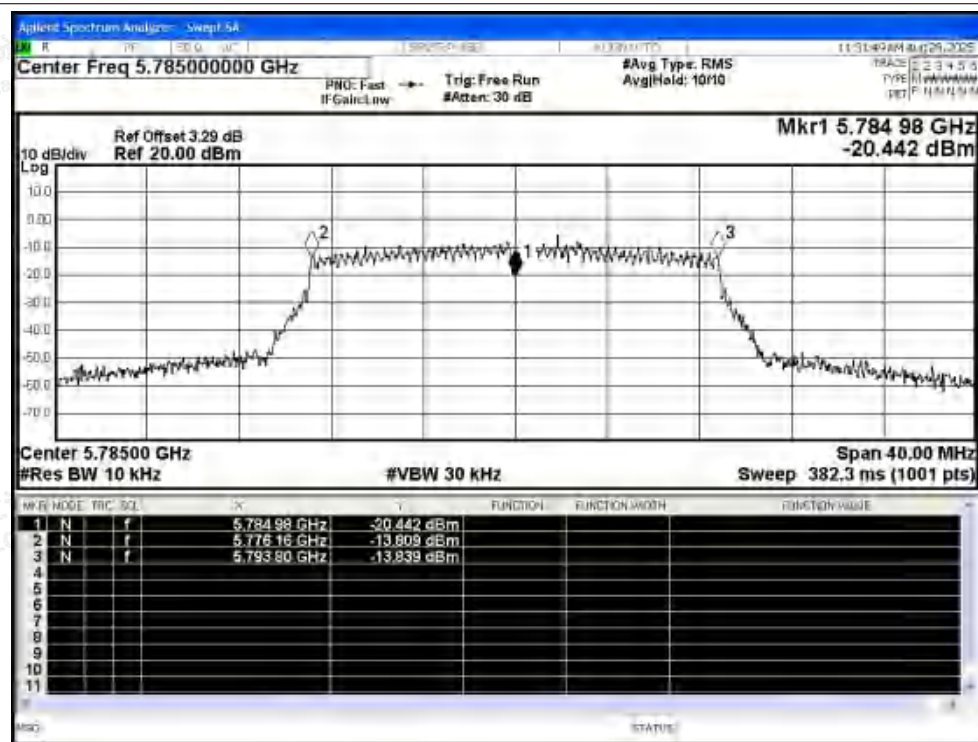

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Freq. Stability NVNT ac20 5825MHz Ant1

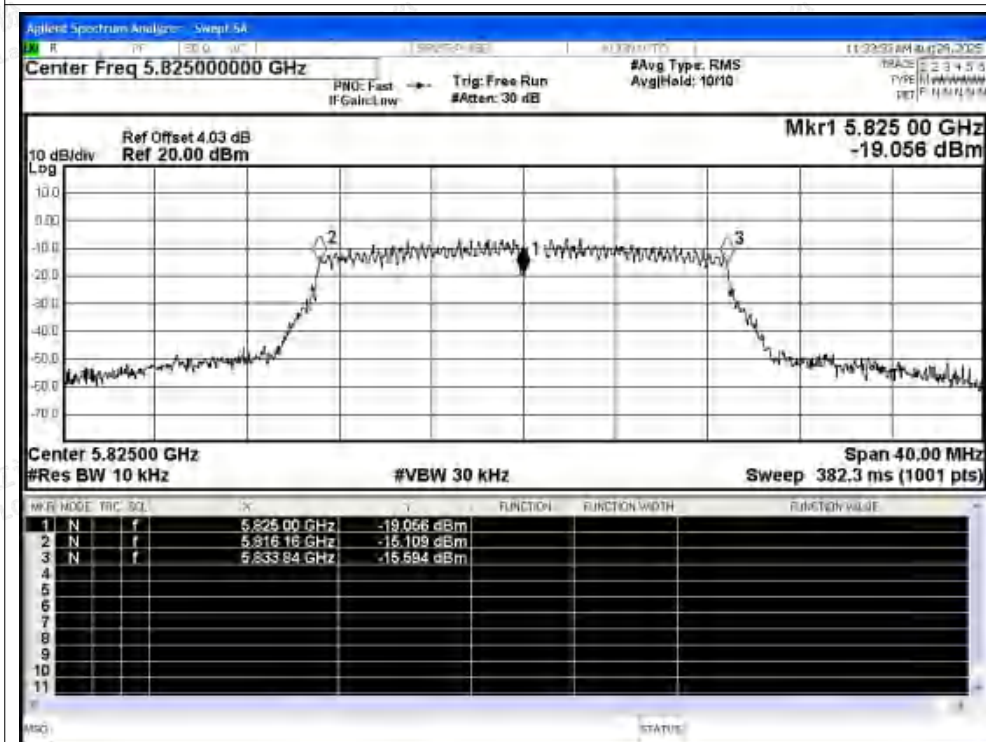


Freq. Stability NVNT ac40 5755MHz Ant1

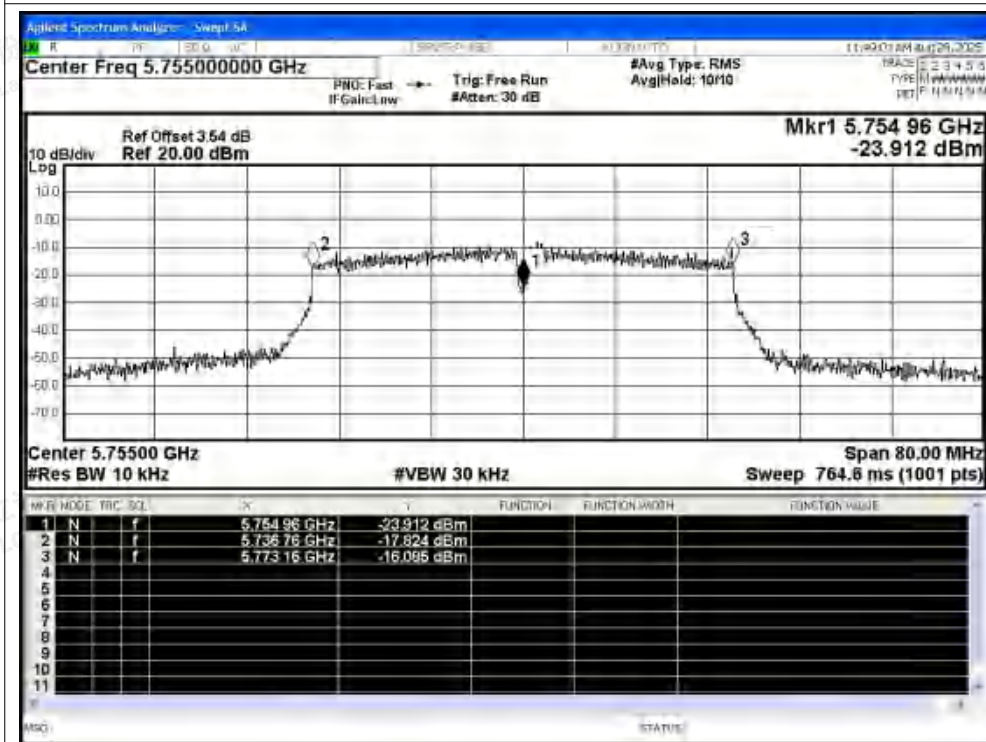




Freq. Stability NVNT ac40 5795MHz Ant1

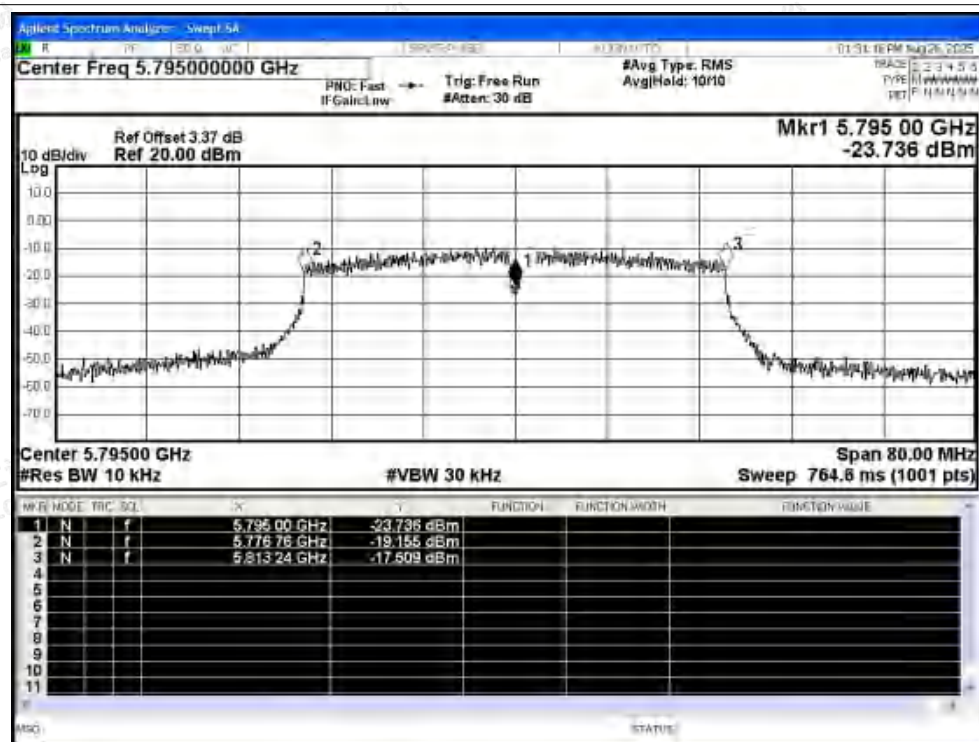

Freq. Stability NVNT ac80 5775MHz Ant1

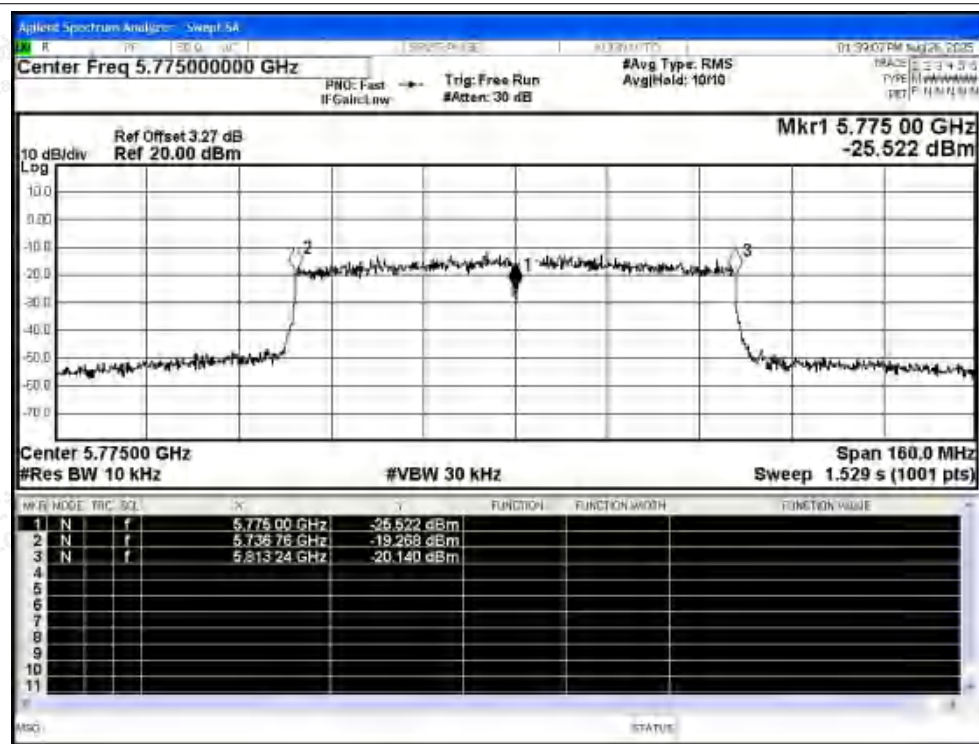

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant1

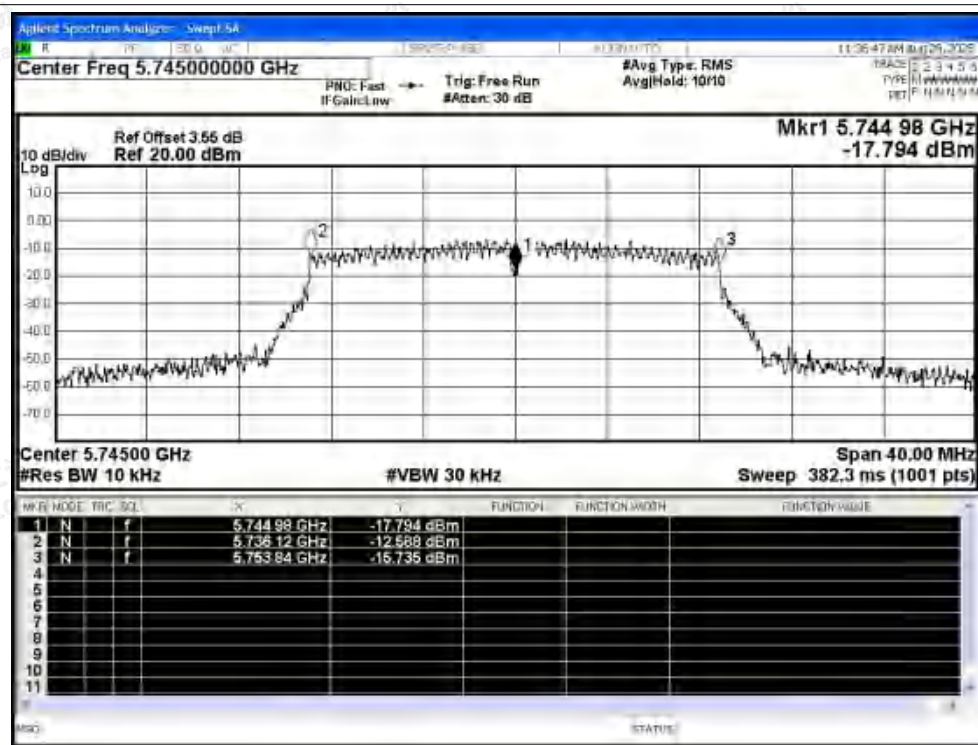

Freq. Stability NVNT ax20 5785MHz Ant1

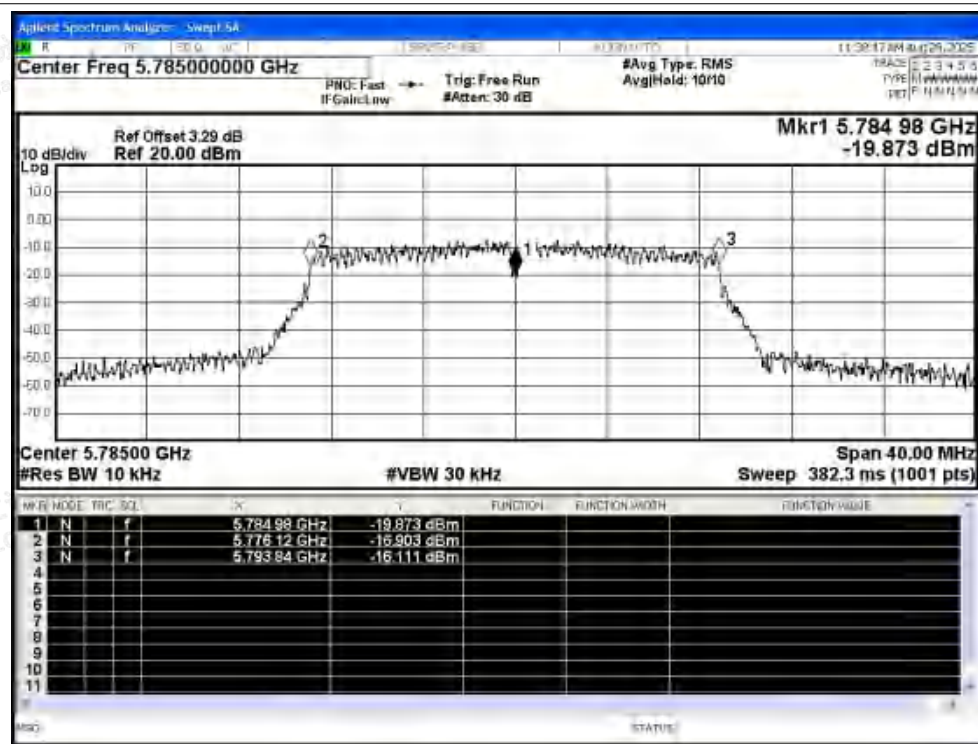

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5825MHz Ant1

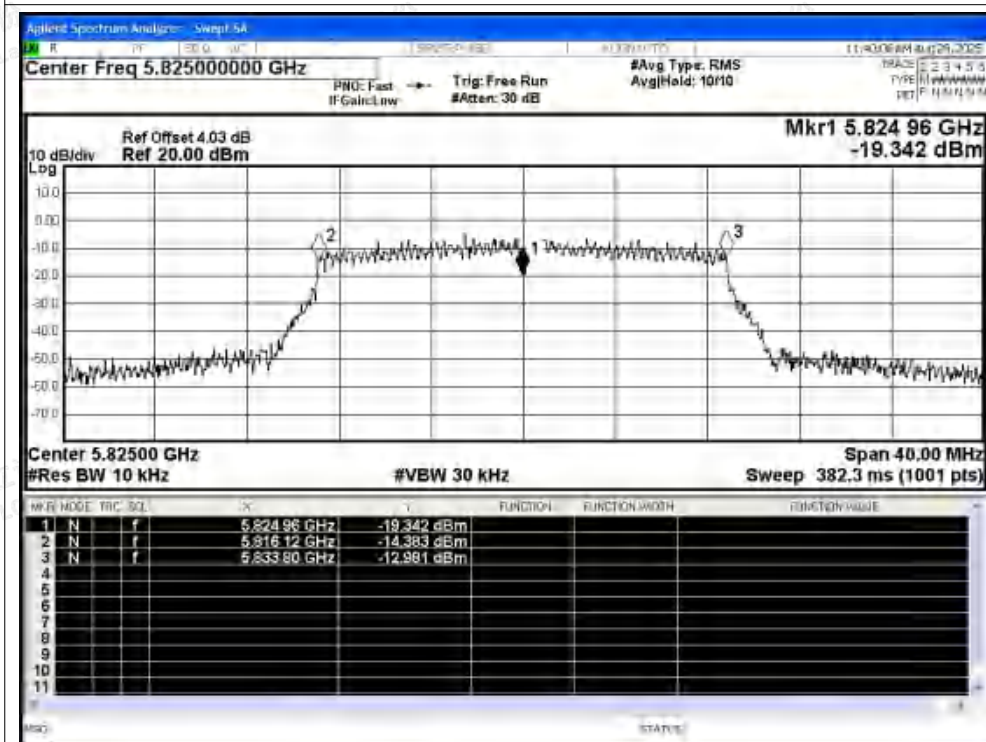


Freq. Stability NVNT ax40 5755MHz Ant1

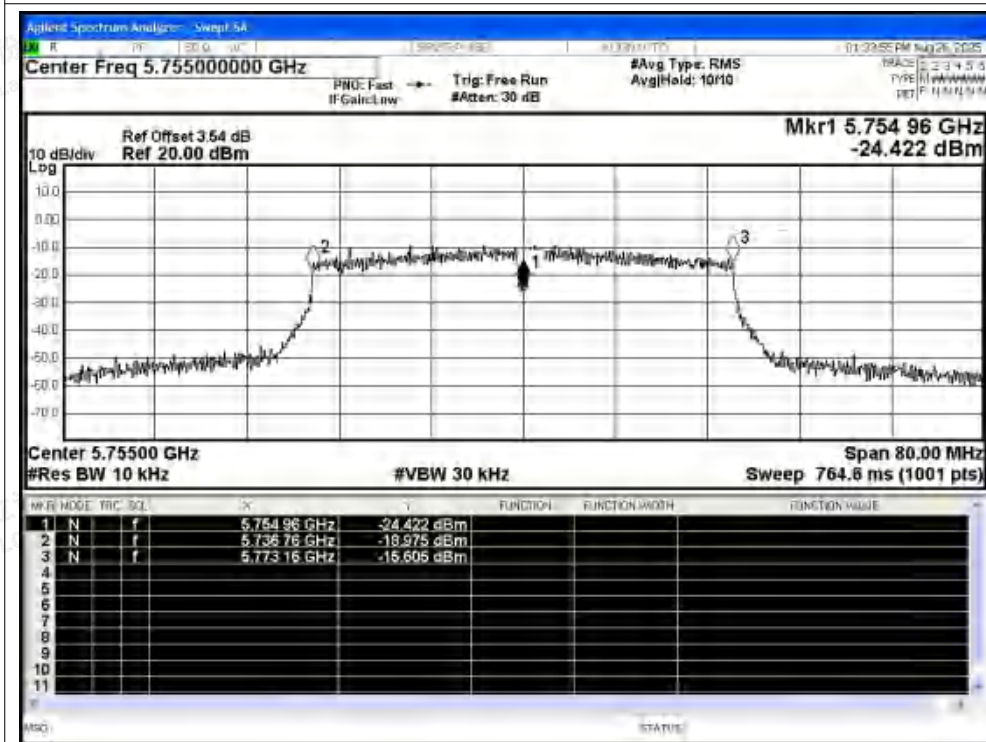





Freq. Stability NVNT ax40 5795MHz Ant1

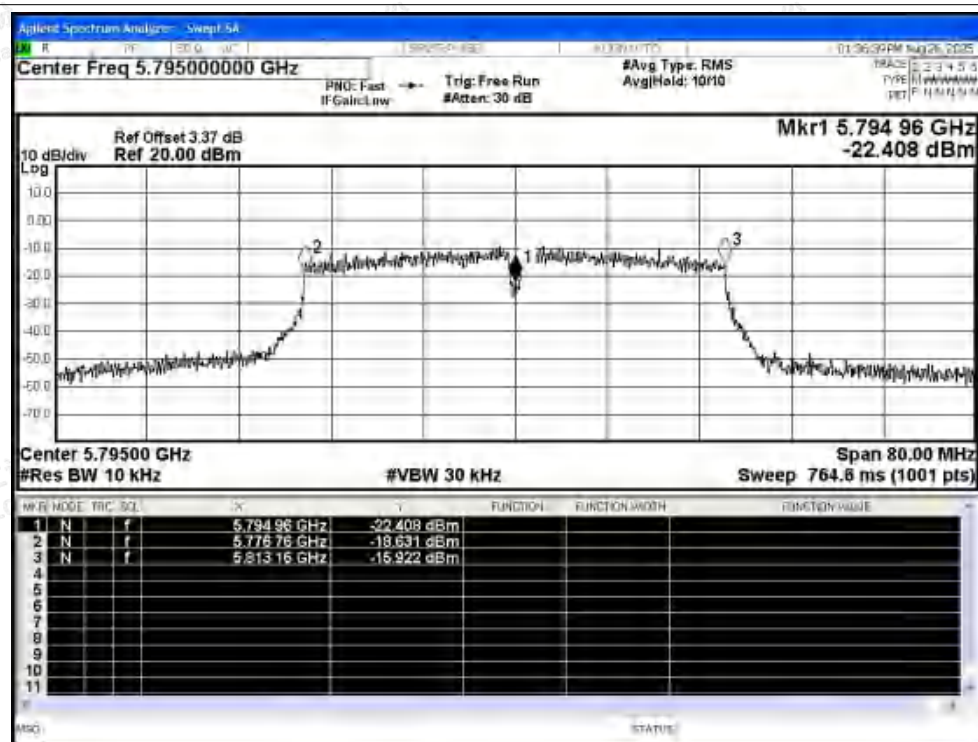

Freq. Stability NVNT ax80 5775MHz Ant1

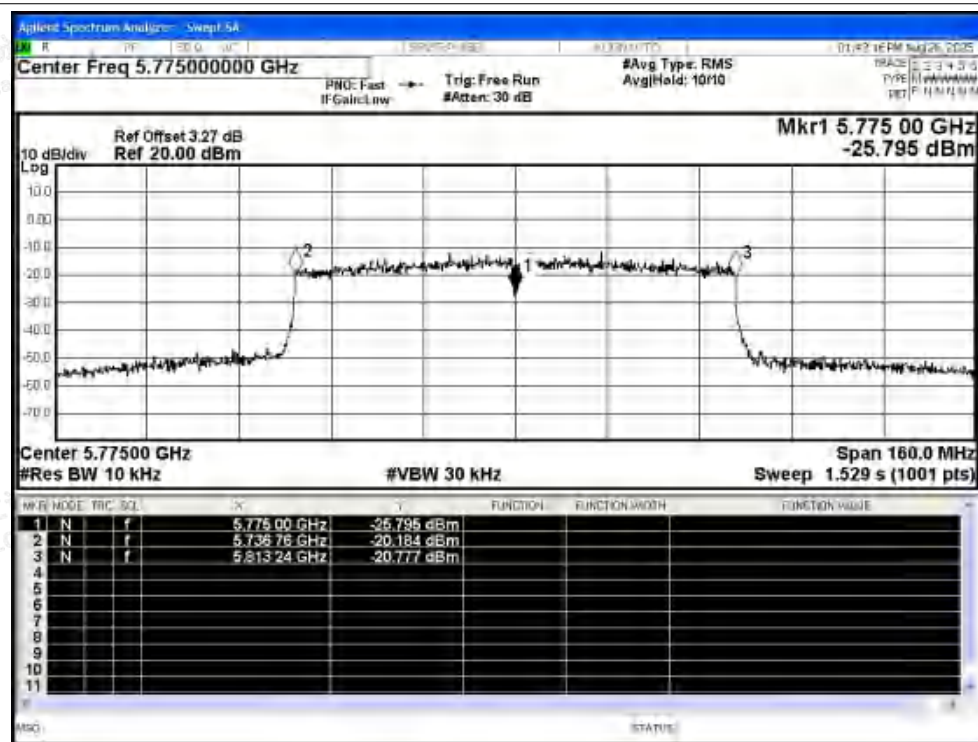



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
NVNT	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
NVNT	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	n20	5745	Ant2	5745	0	0	25	Pass
NVNT	n20	5785	Ant2	5784.96	-40000	-6.91	25	Pass
NVNT	n20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	n40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
NVNT	ac20	5745	Ant2	5745	0	0	25	Pass
NVNT	ac20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
NVNT	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant2	5795	0	0	25	Pass
NVNT	ac80	5775	Ant2	5775	0	0	25	Pass
NVNT	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
NVNT	ax20	5785	Ant2	5785	0	0	25	Pass
NVNT	ax20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	ax40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	ax40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant2	5775	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5745MHz Ant2

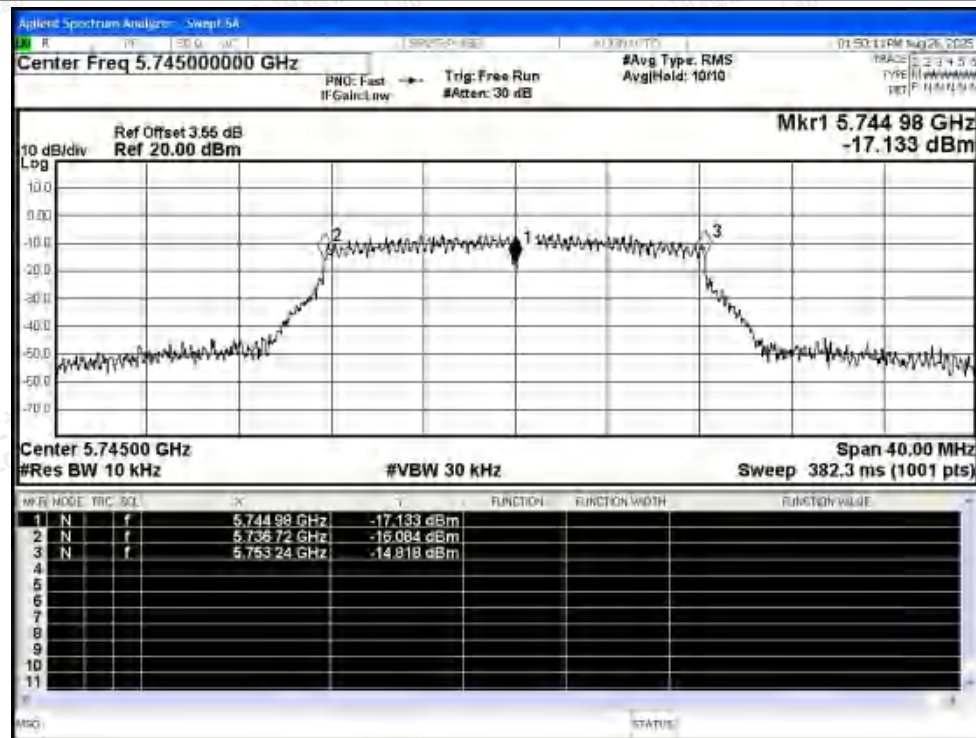

Freq. Stability NVNT a 5785MHz Ant2

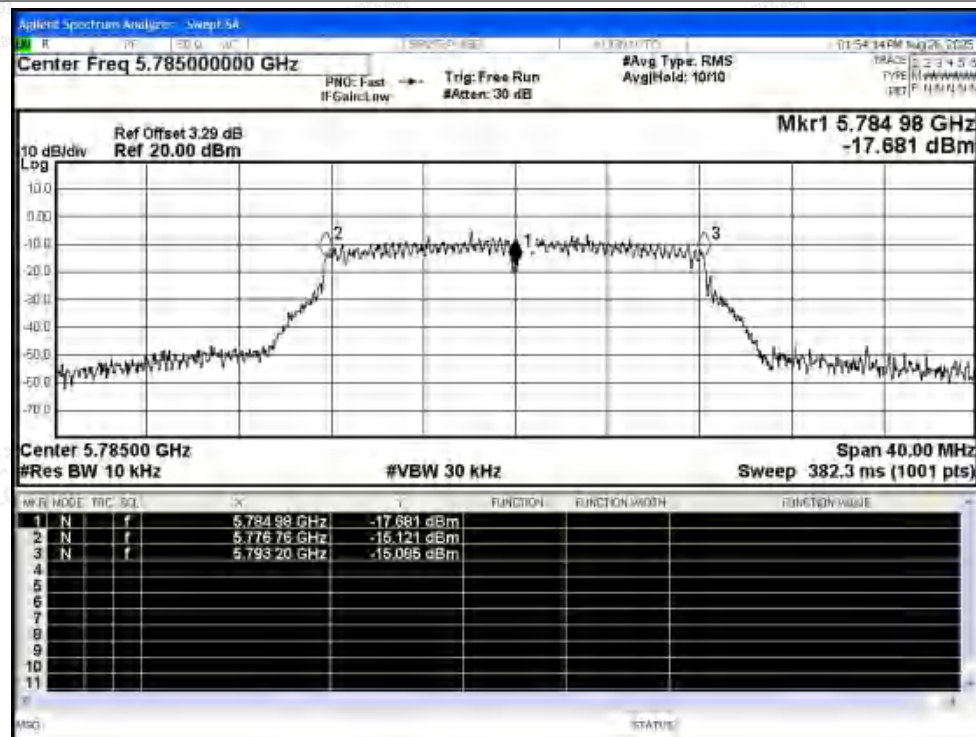

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant2

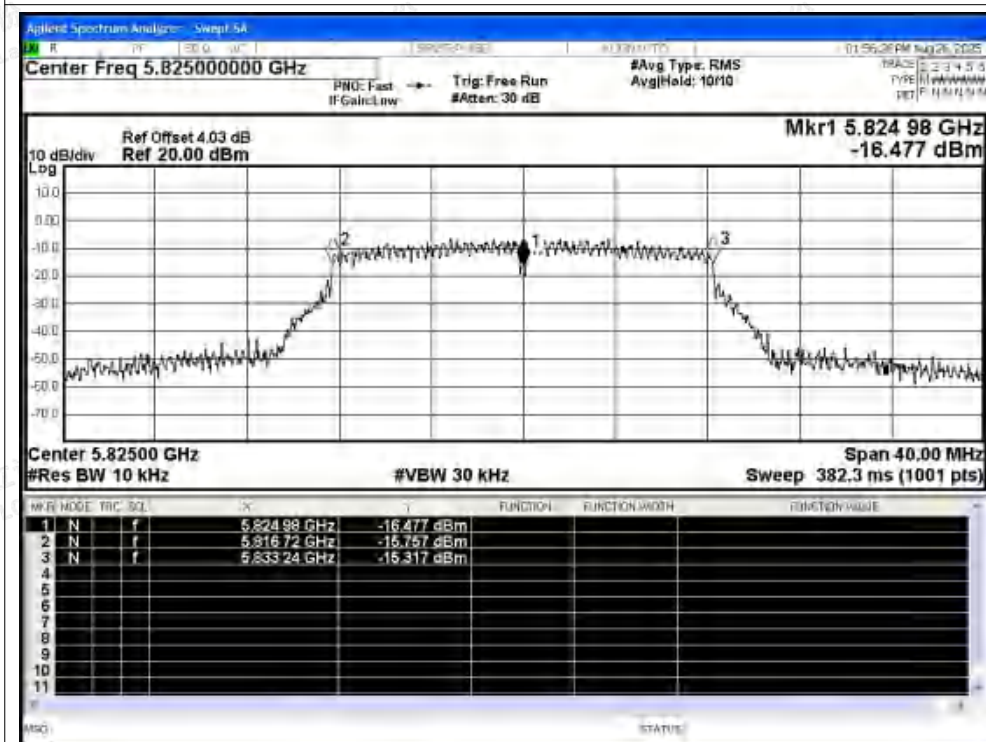

Freq. Stability NVNT n20 5745MHz Ant2

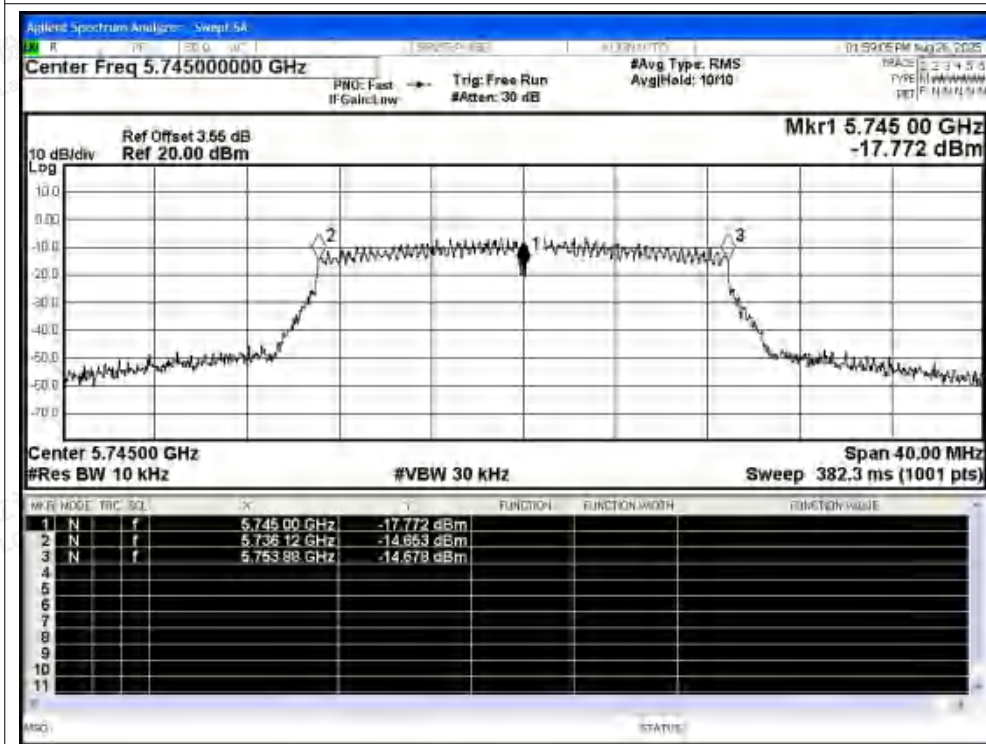

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant2

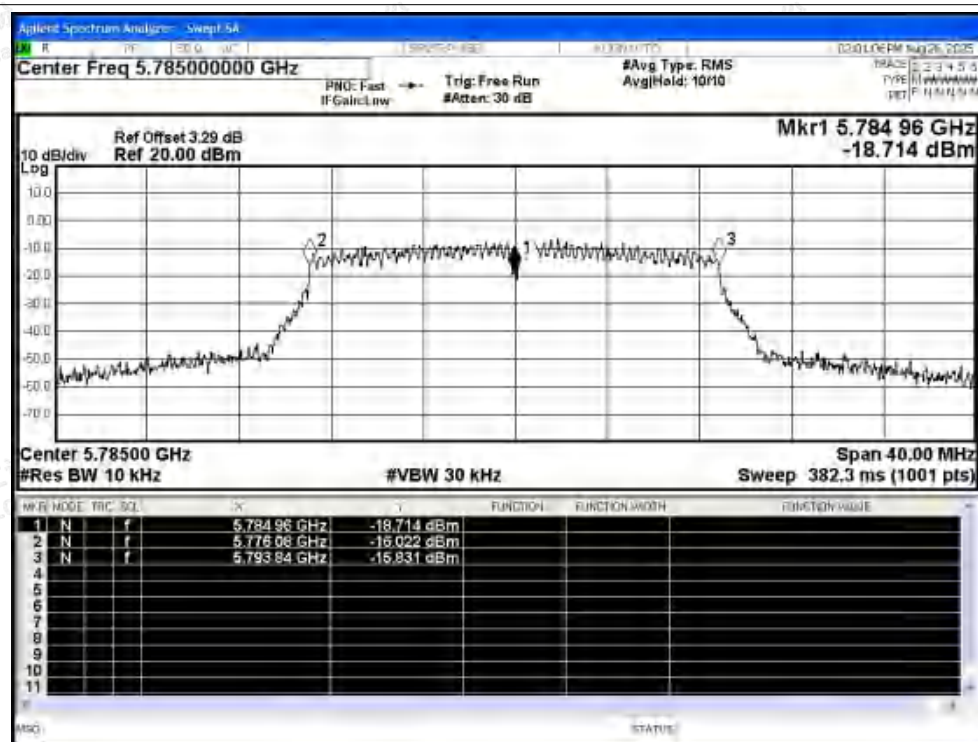

Freq. Stability NVNT n20 5825MHz Ant2

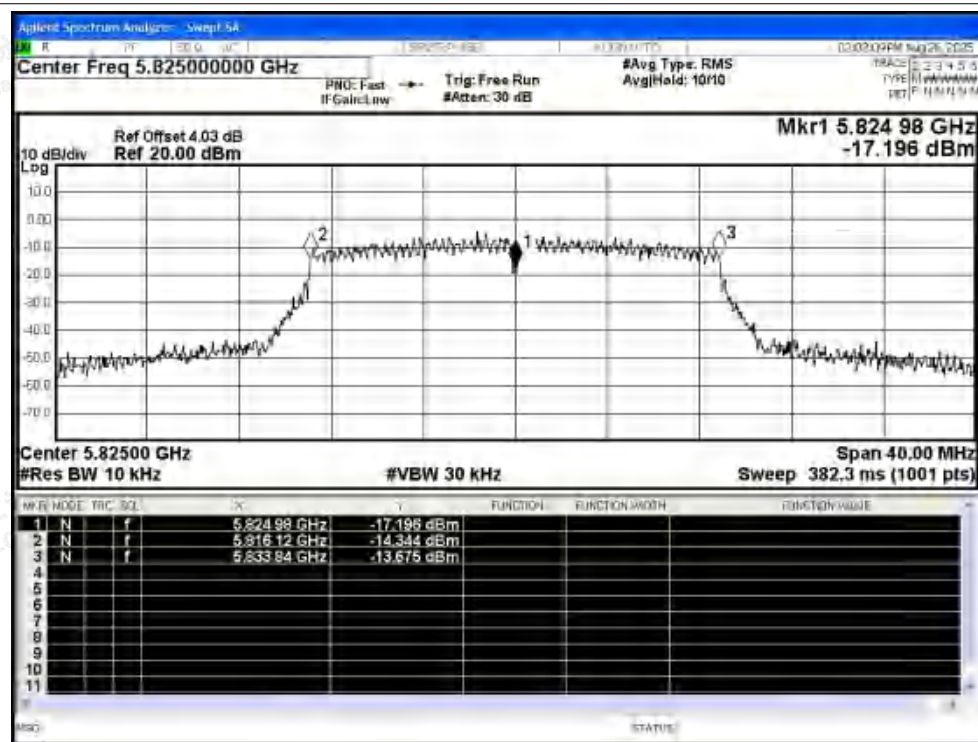

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant2

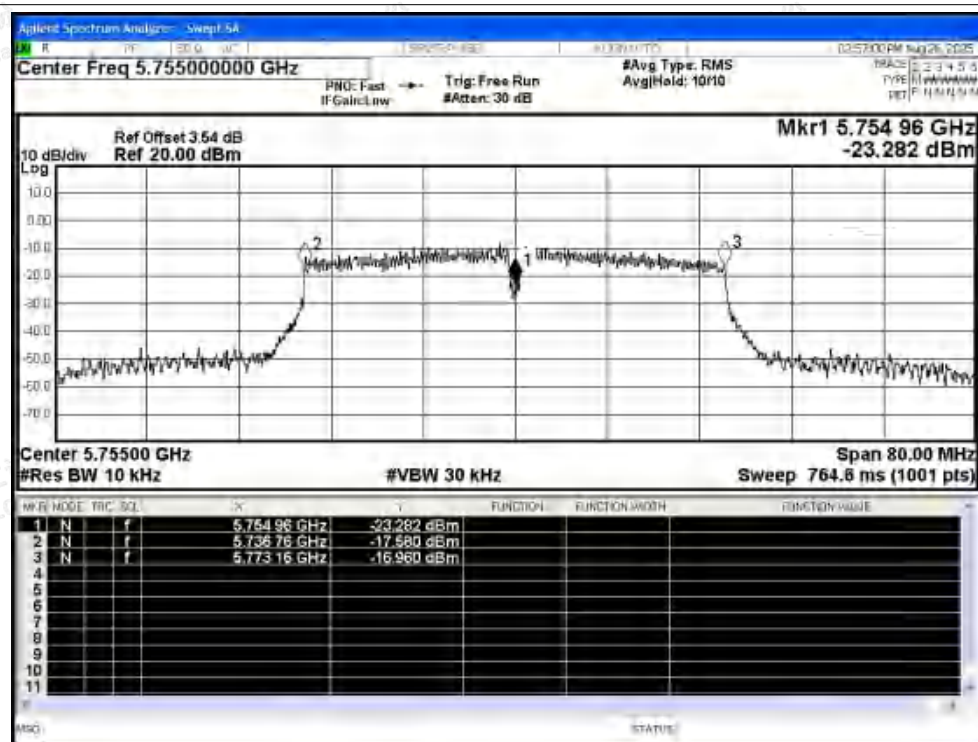


Freq. Stability NVNT n40 5795MHz Ant2

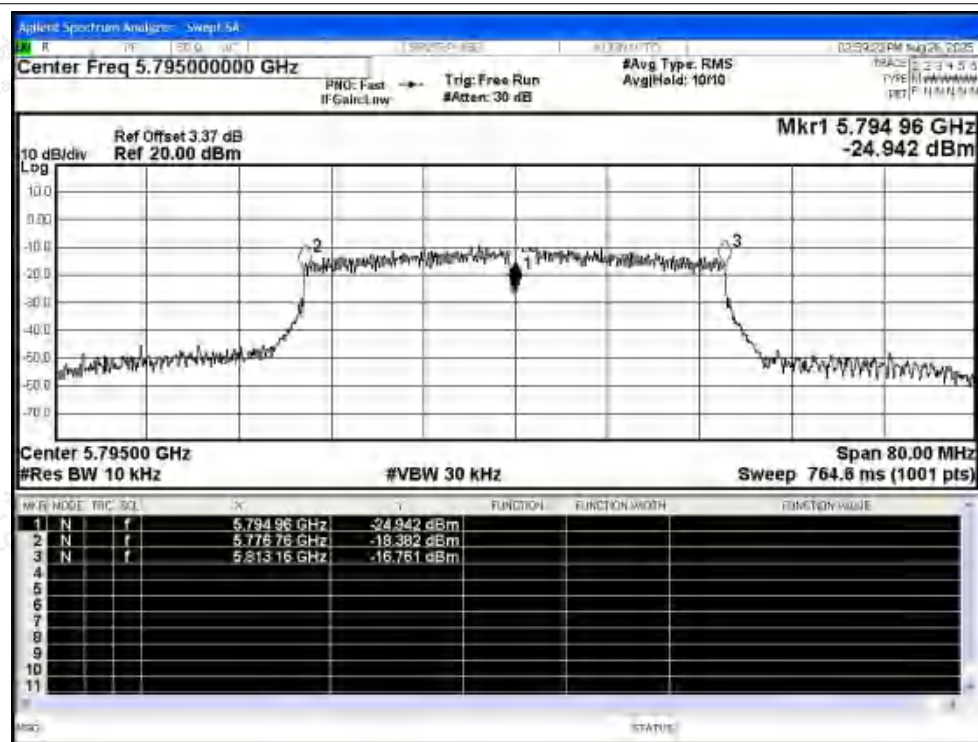




Freq. Stability NVNT ac20 5745MHz Ant2

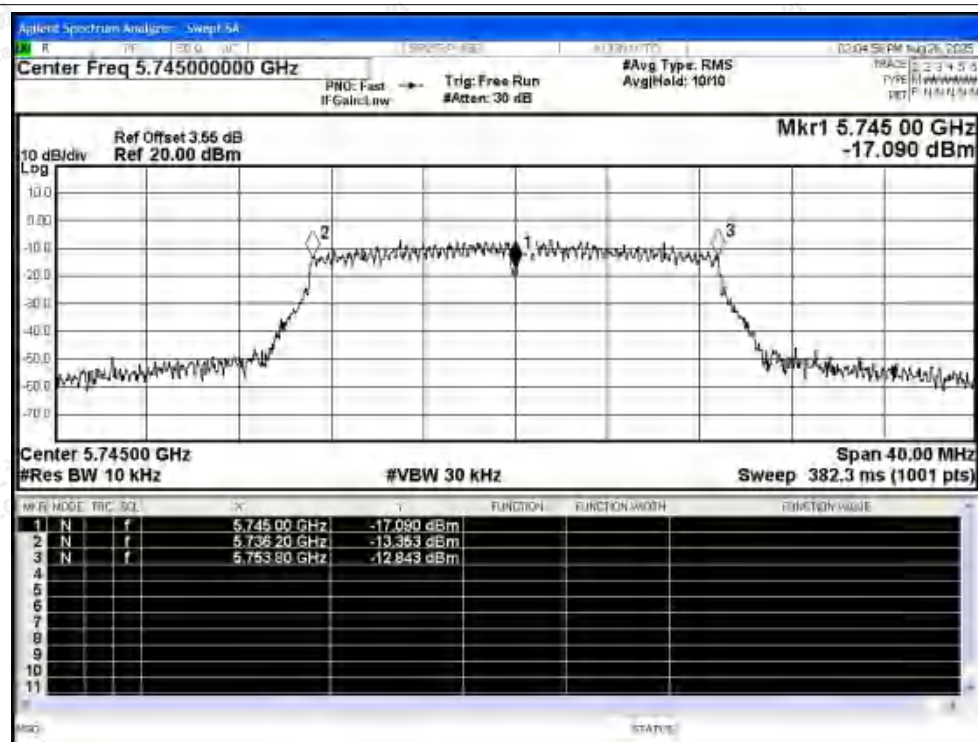

Freq. Stability NVNT ac20 5785MHz Ant2

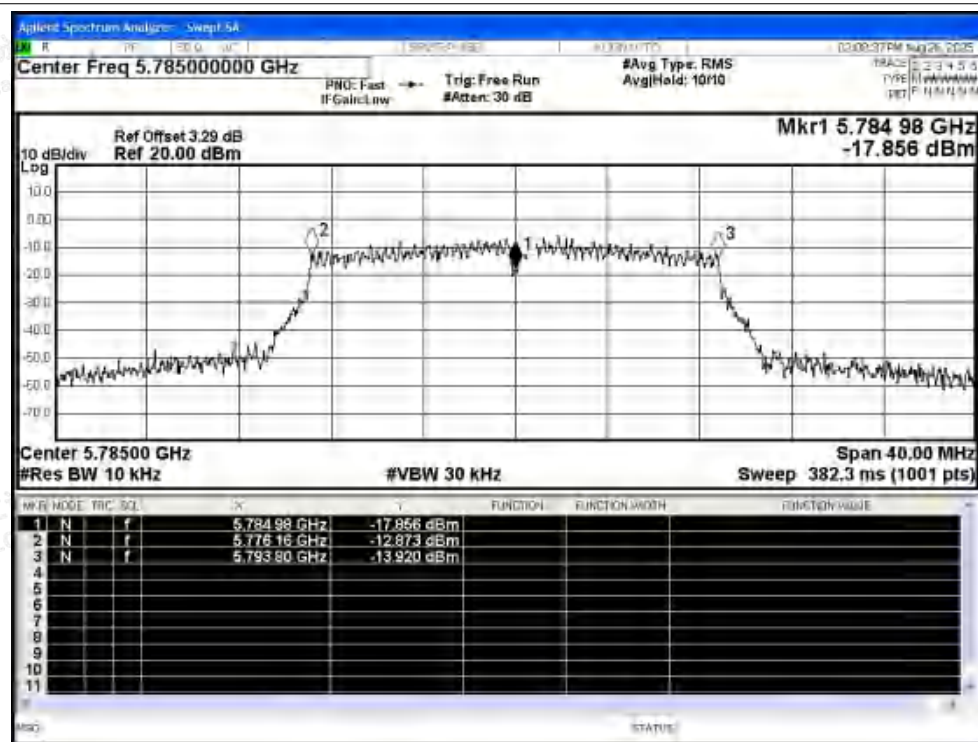

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant2

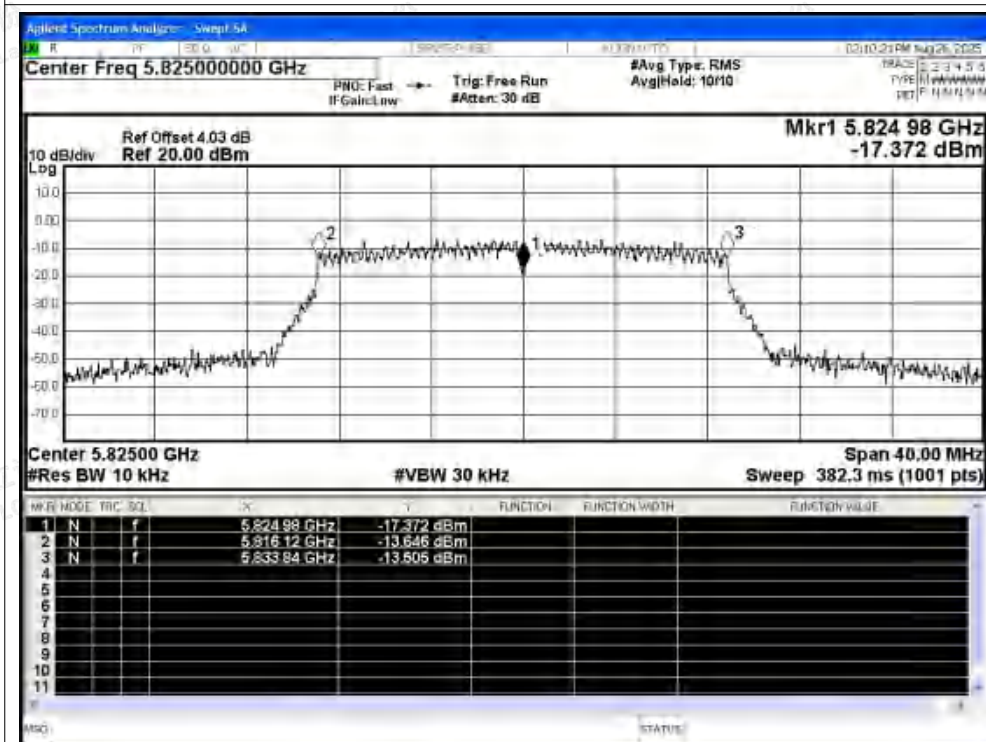


Freq. Stability NVNT ac40 5755MHz Ant2

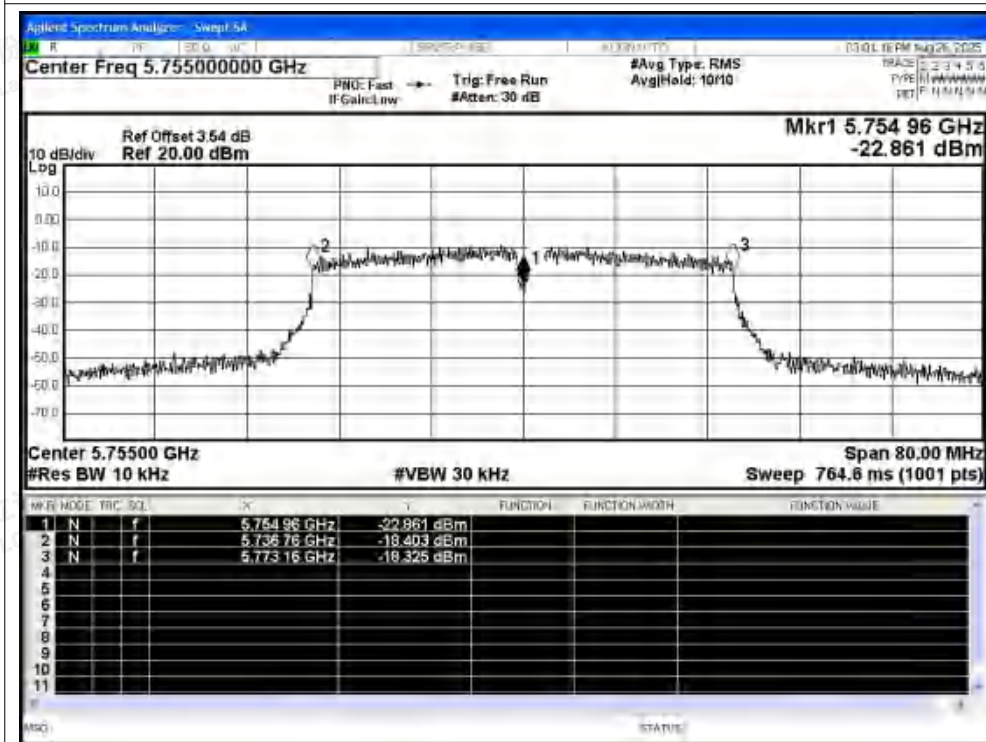




Freq. Stability NVNT ac40 5795MHz Ant2

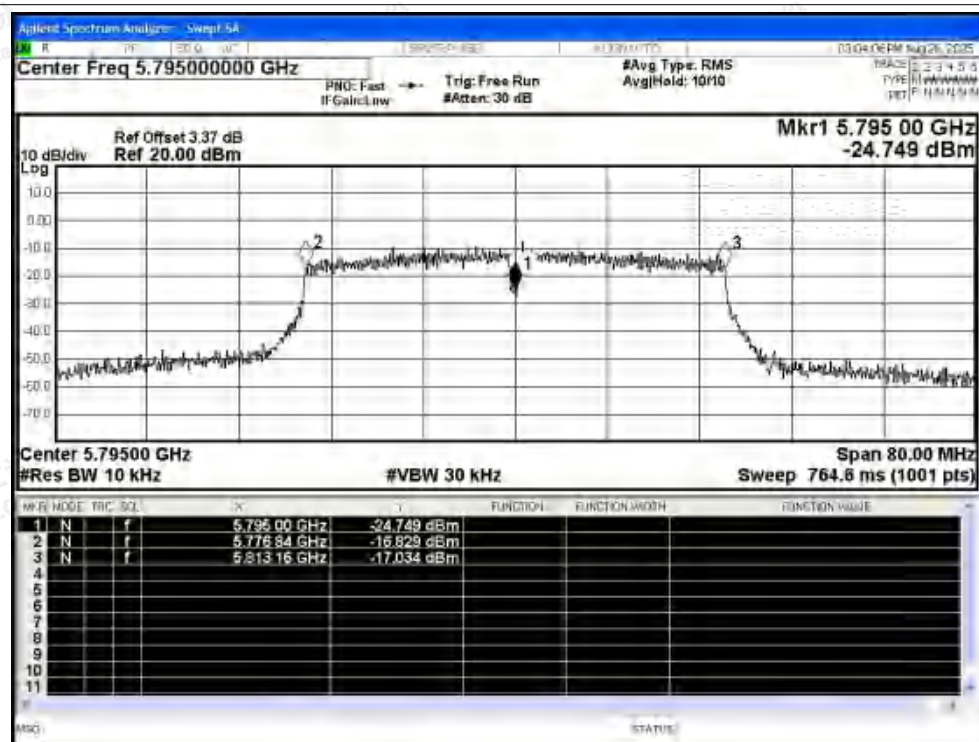

Freq. Stability NVNT ac80 5775MHz Ant2

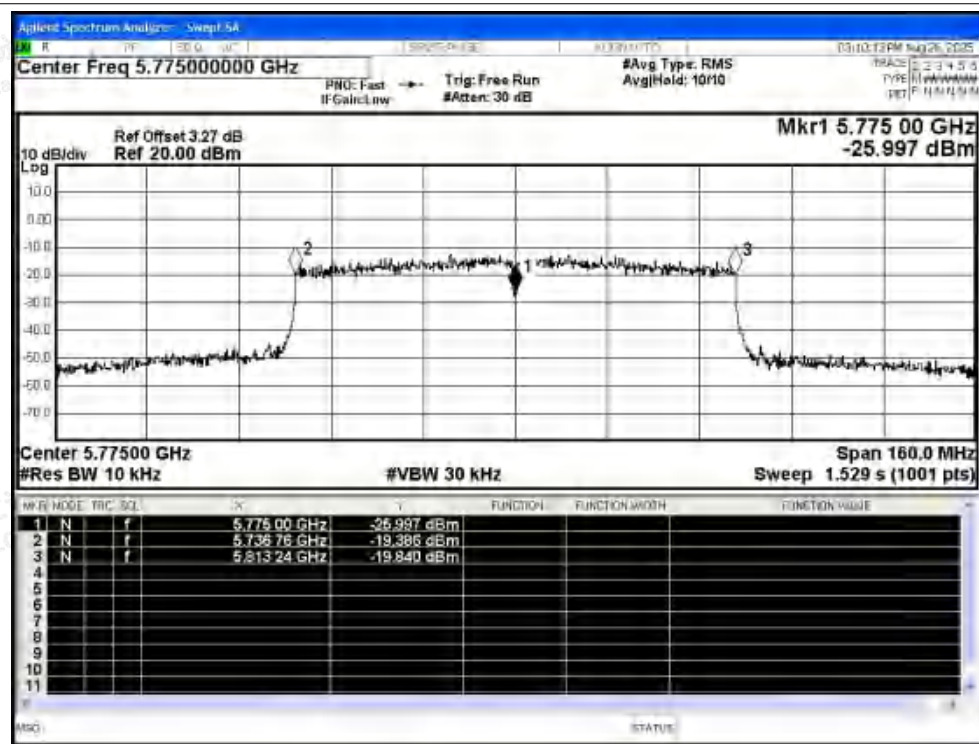

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant2

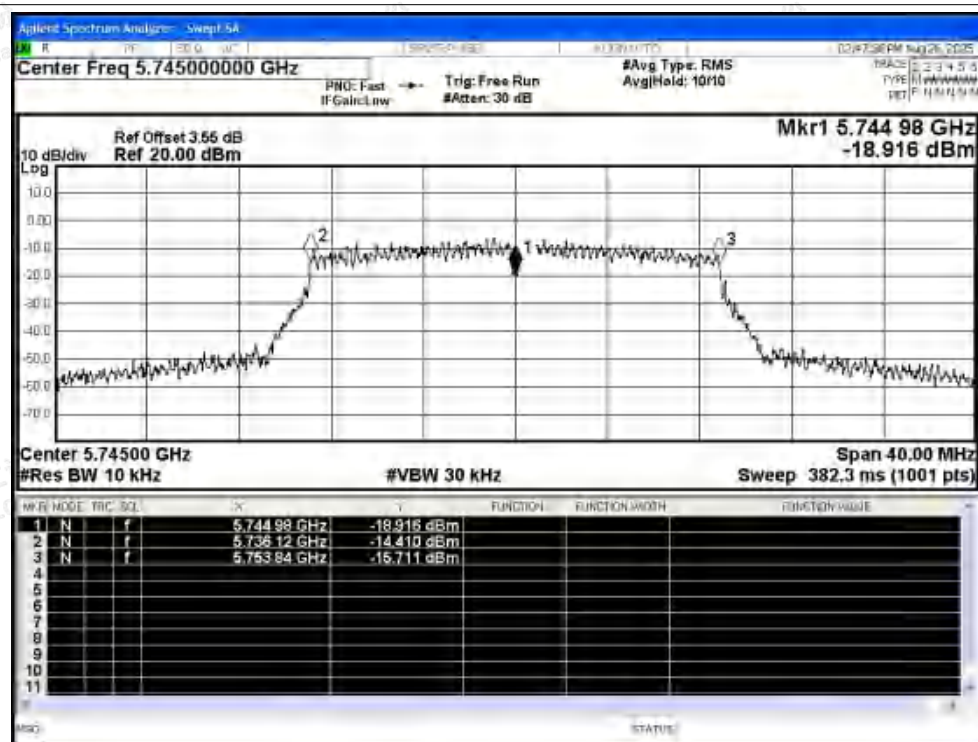


Freq. Stability NVNT ax20 5785MHz Ant2

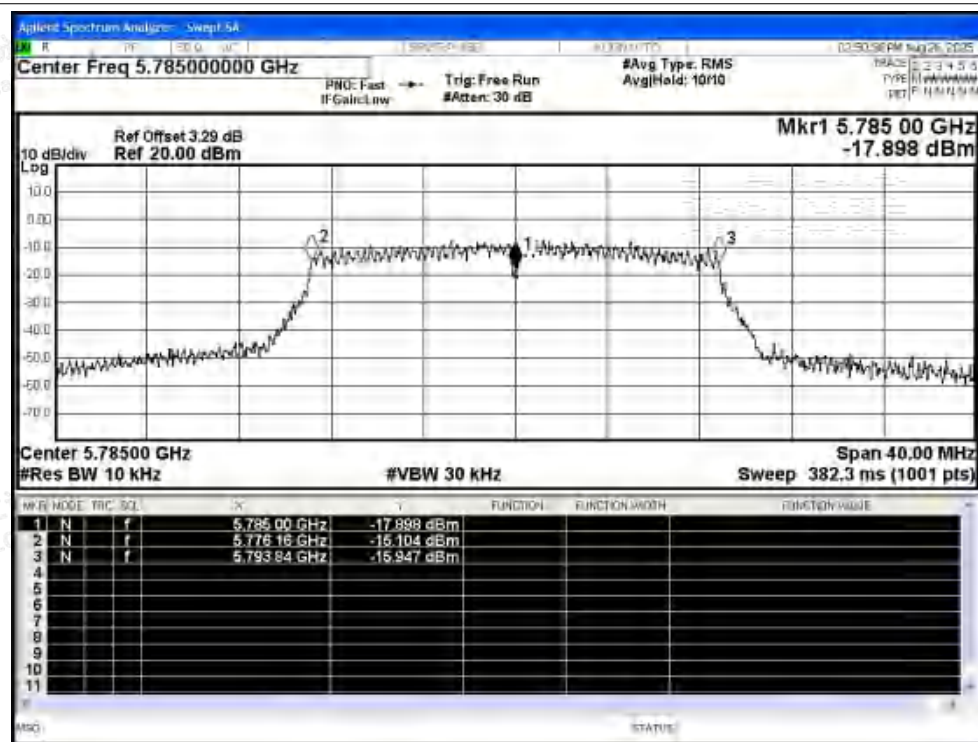




Freq. Stability NVNT ax20 5825MHz Ant2

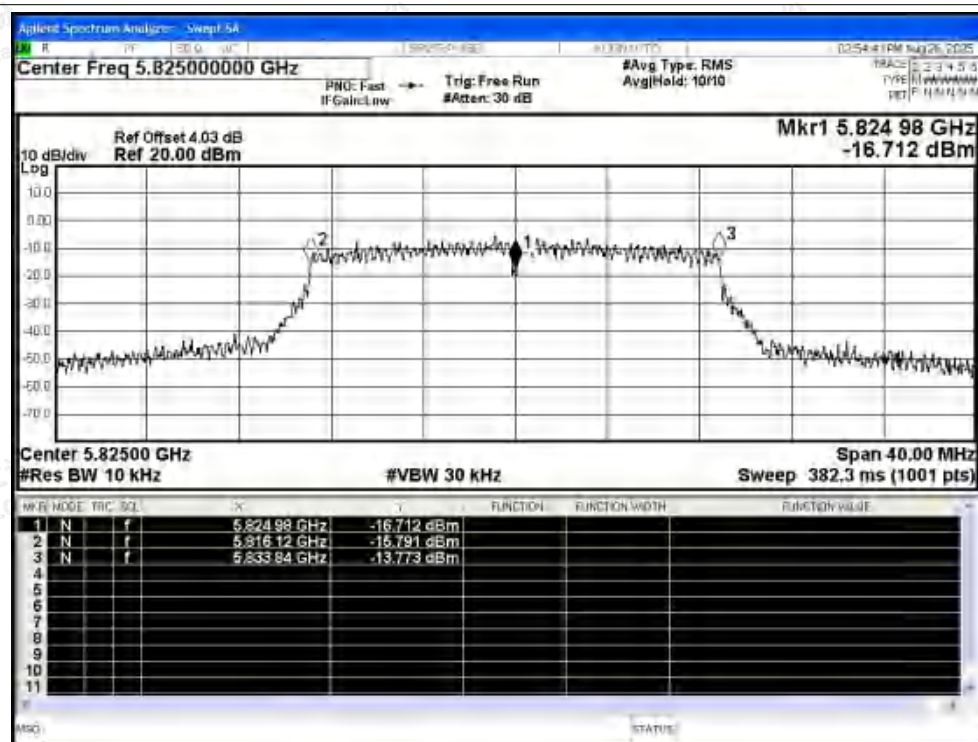


Freq. Stability NVNT ax40 5755MHz Ant2

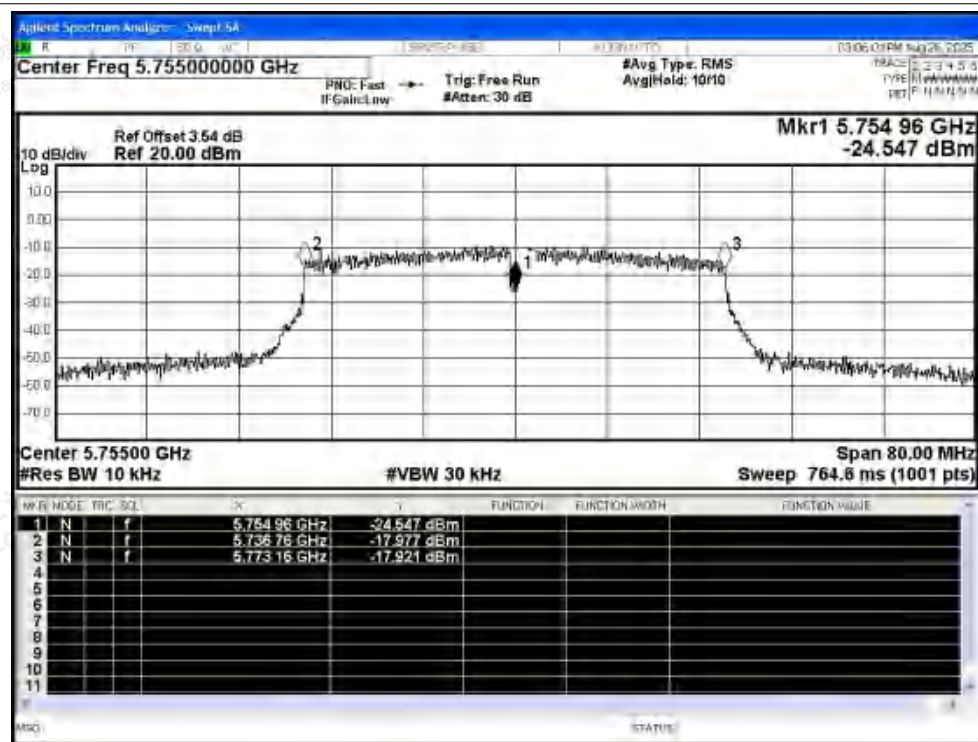





Freq. Stability NVNT ax40 5795MHz Ant2

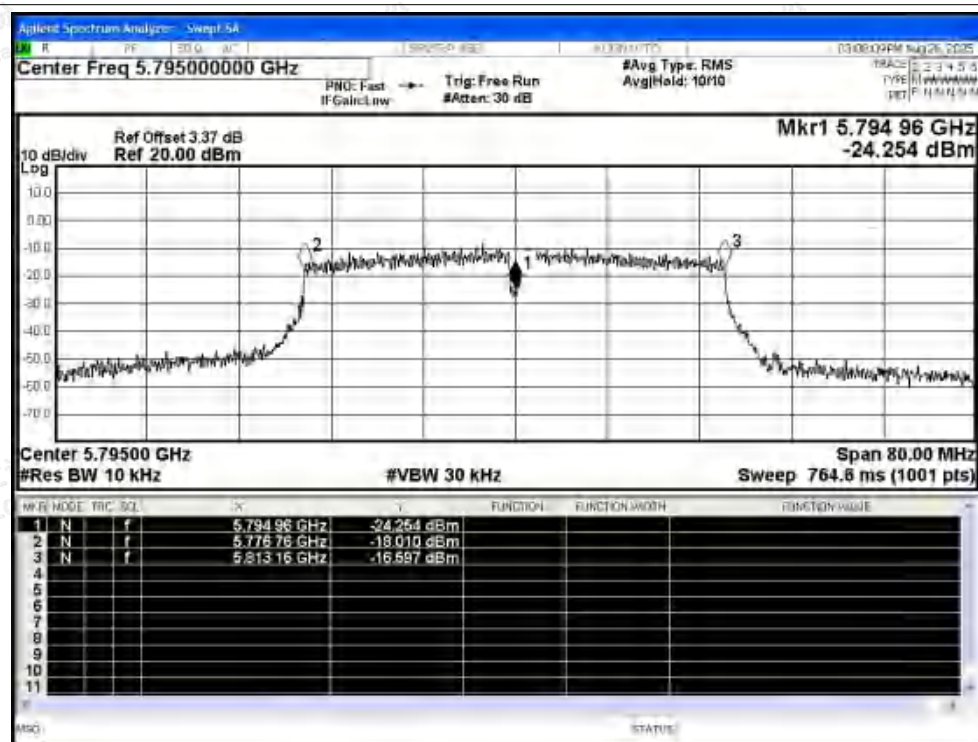

Freq. Stability NVNT ax80 5775MHz Ant2

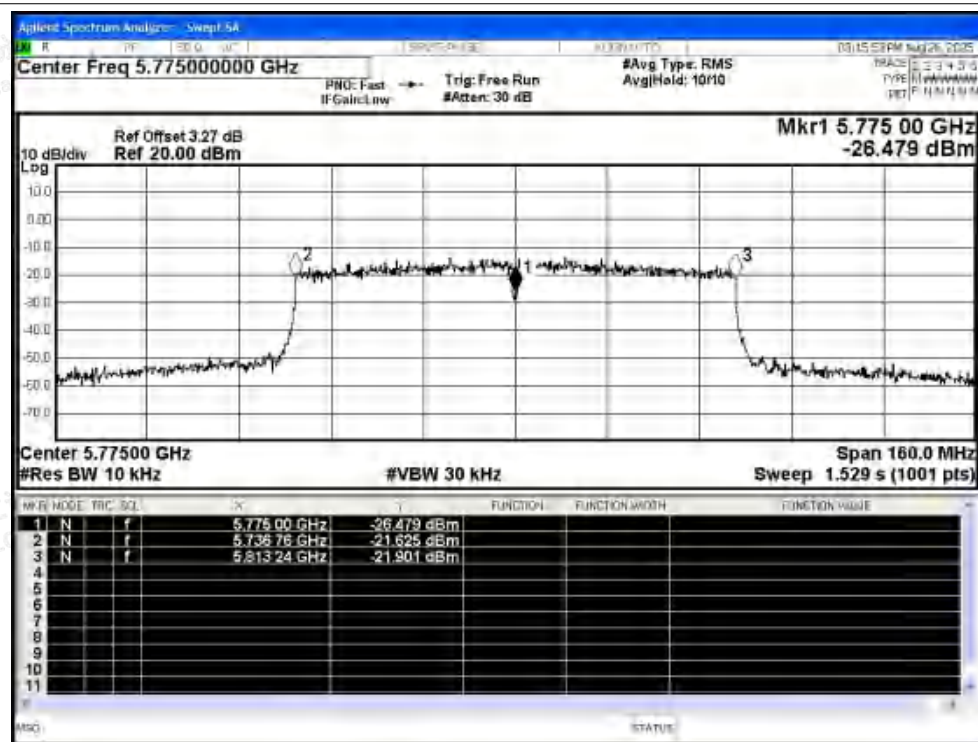



D.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant1	97.62	0.1	0.72
NVNT	a	5785	Ant1	97.48	0.11	0.72
NVNT	a	5825	Ant1	97.62	0.1	0.72
NVNT	n20	5745	Ant1	97.45	0.11	0.77
NVNT	n20	5785	Ant1	97.46	0.11	0.77
NVNT	n20	5825	Ant1	97.53	0.11	0.77
NVNT	n40	5755	Ant1	94.88	0.23	1.54
NVNT	n40	5795	Ant1	95.01	0.22	1.54
NVNT	ac20	5745	Ant1	97.53	0.11	0.77
NVNT	ac20	5785	Ant1	97.46	0.11	0.77
NVNT	ac20	5825	Ant1	97.46	0.11	0.77
NVNT	ac40	5755	Ant1	95.05	0.22	1.53
NVNT	ac40	5795	Ant1	94.91	0.23	1.53
NVNT	ac80	5775	Ant1	90.53	0.43	3.08
NVNT	ax20	5745	Ant1	97.48	0.11	0.76
NVNT	ax20	5785	Ant1	97.48	0.11	0.76
NVNT	ax20	5825	Ant1	97.48	0.11	0.76
NVNT	ax40	5755	Ant1	95.2	0.21	1.53
NVNT	ax40	5795	Ant1	95.05	0.22	1.53
NVNT	ax80	5775	Ant1	90.53	0.43	3.08



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5745MHz Ant1

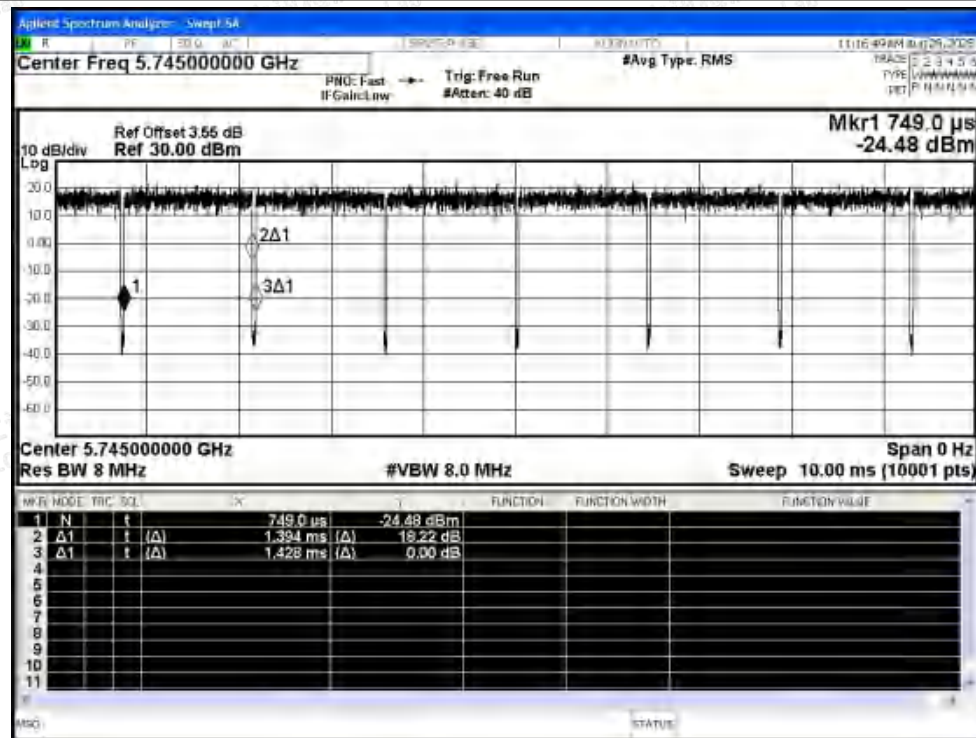

Duty Cycle NVNT a 5785MHz Ant1

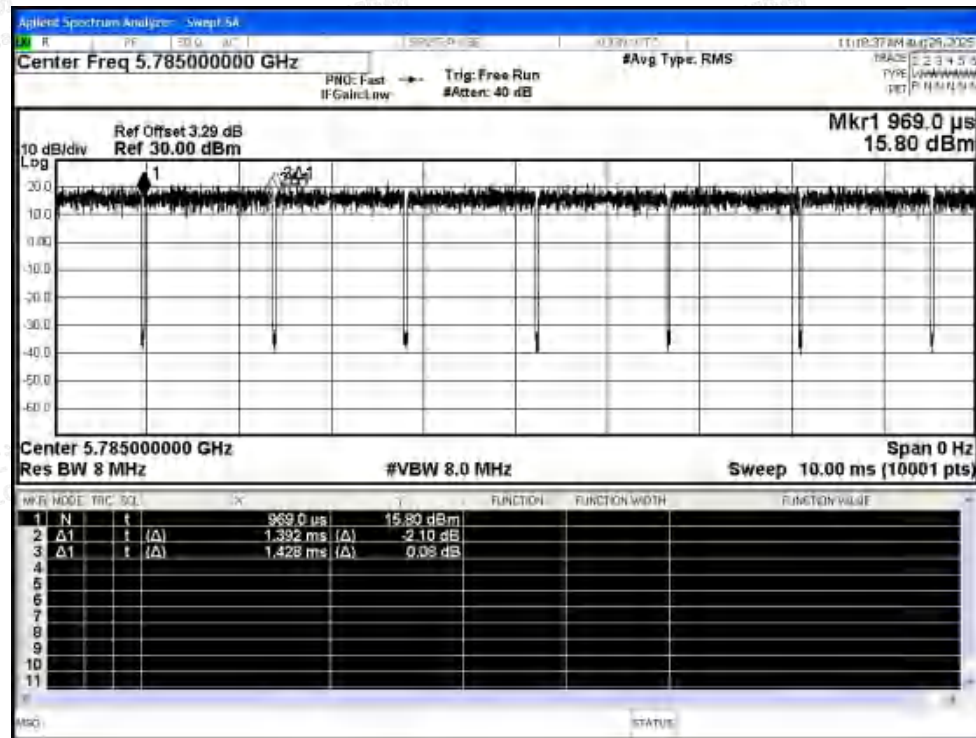

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5825MHz Ant1

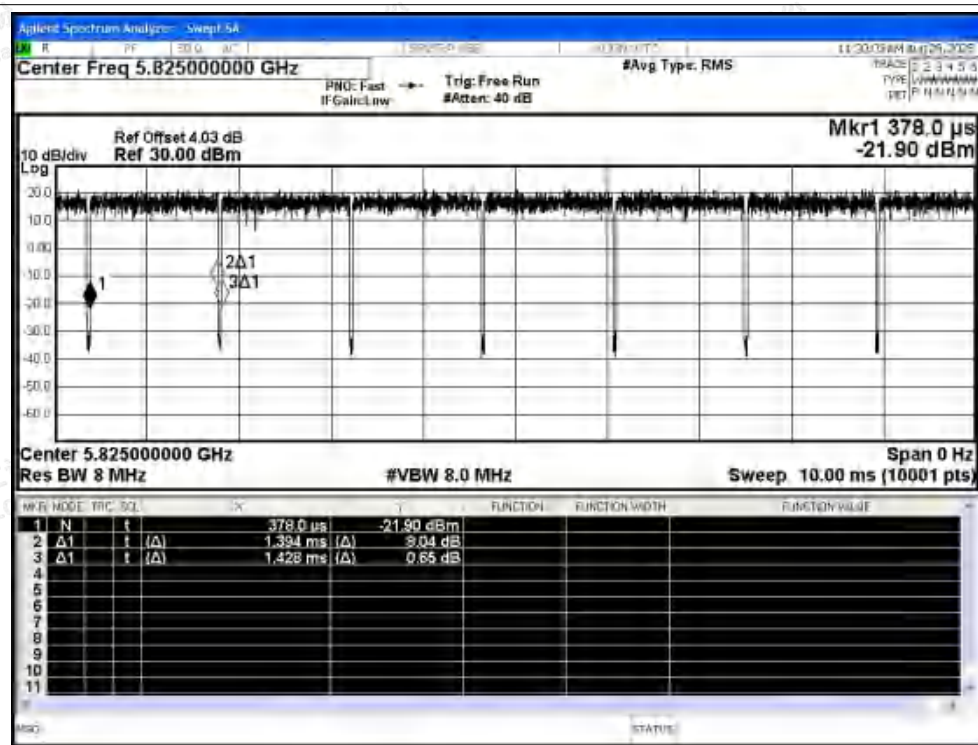

Duty Cycle NVNT n20 5745MHz Ant1

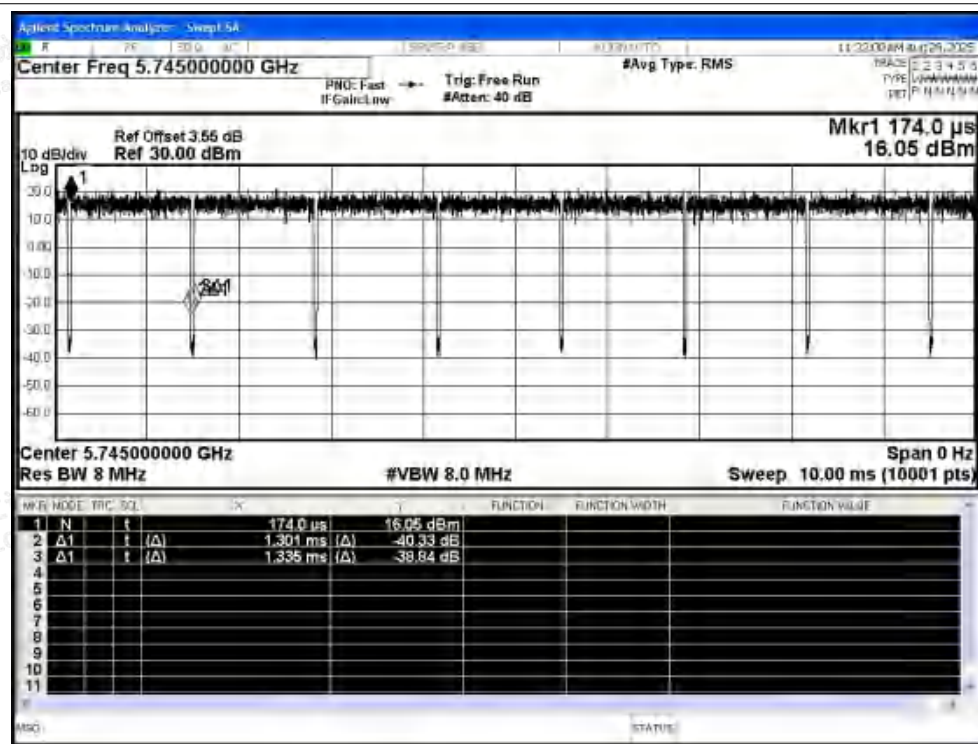


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5785MHz Ant1

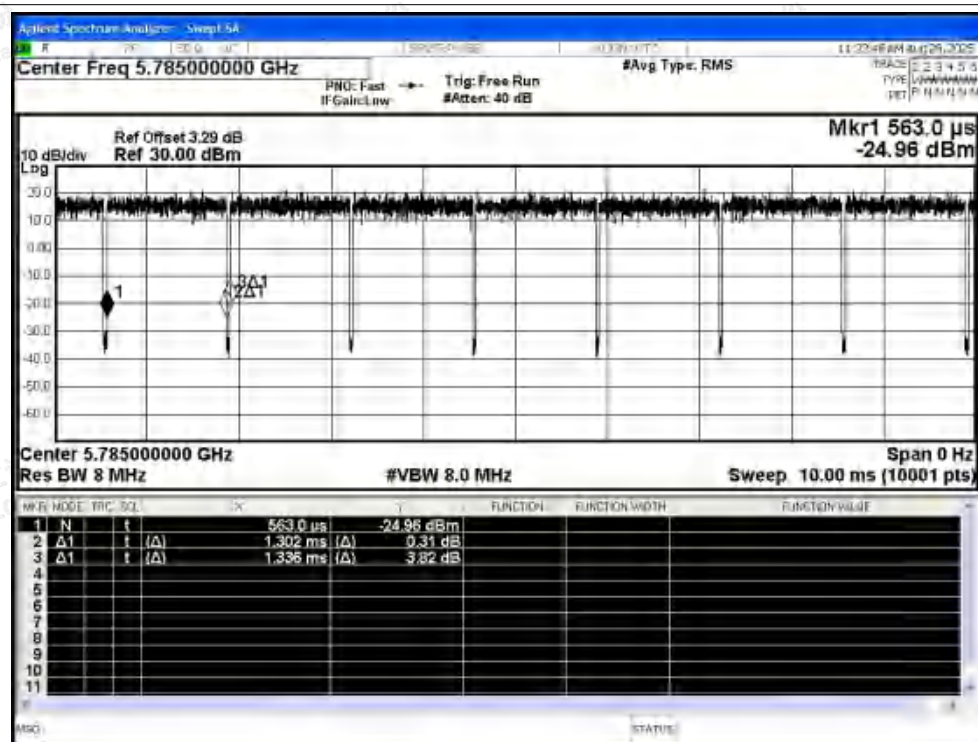

Duty Cycle NVNT n20 5825MHz Ant1

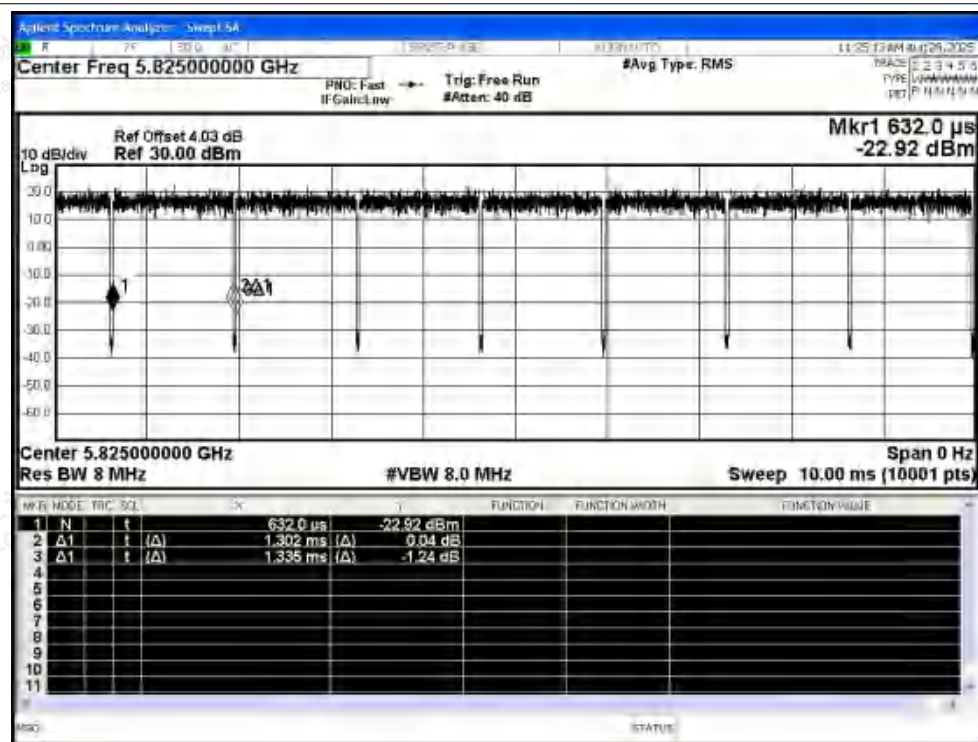


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5755MHz Ant1

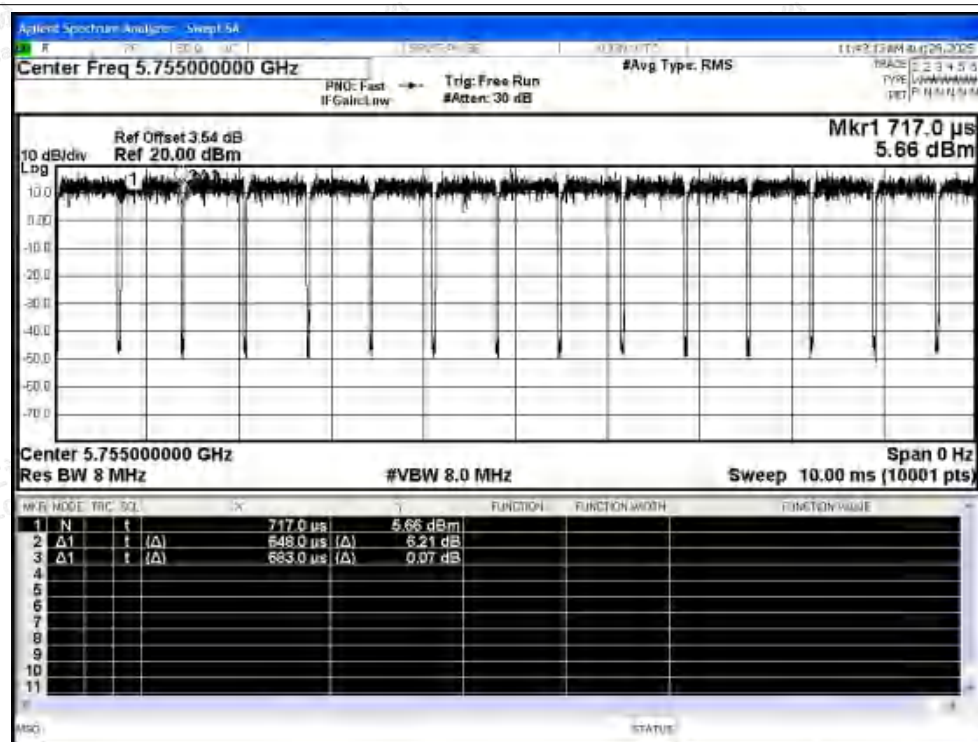

Duty Cycle NVNT n40 5795MHz Ant1

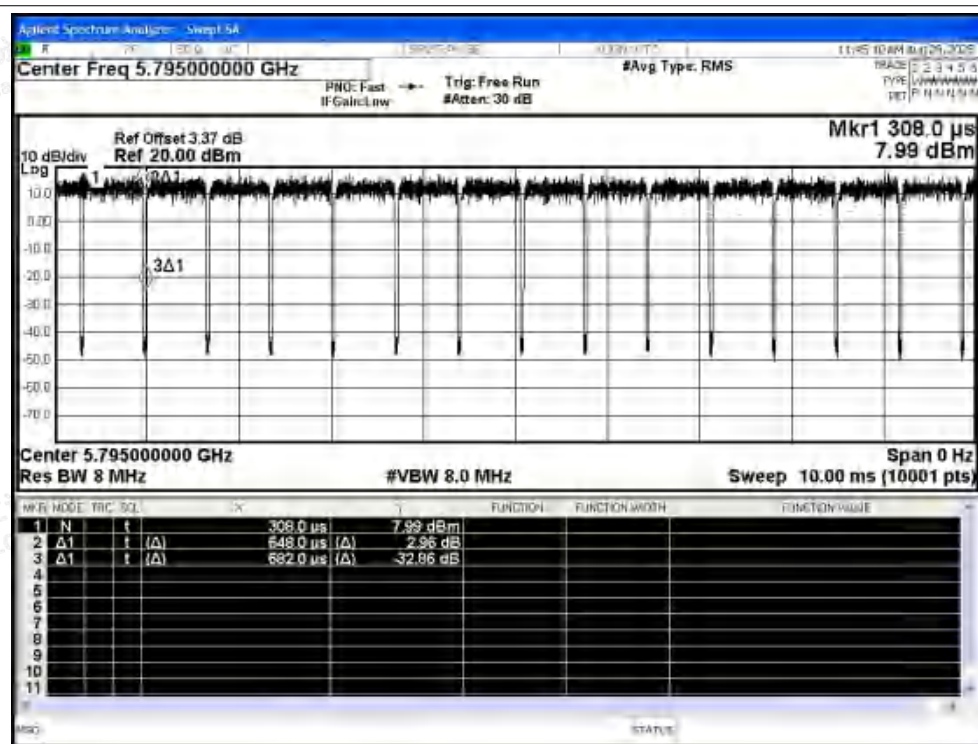

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5745MHz Ant1

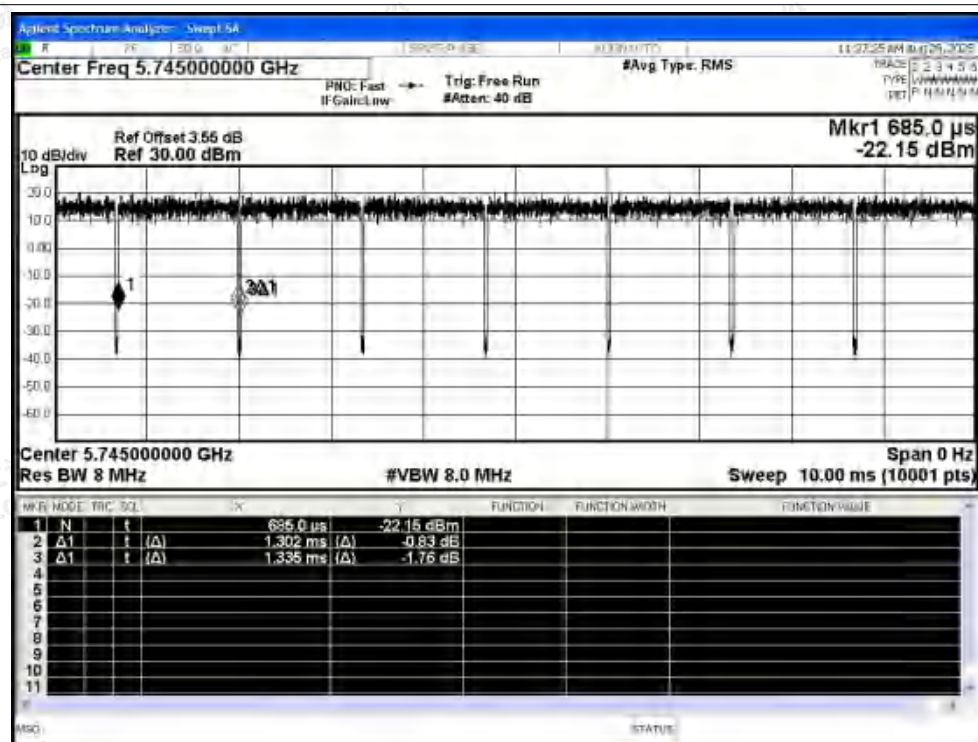

Duty Cycle NVNT ac20 5785MHz Ant1

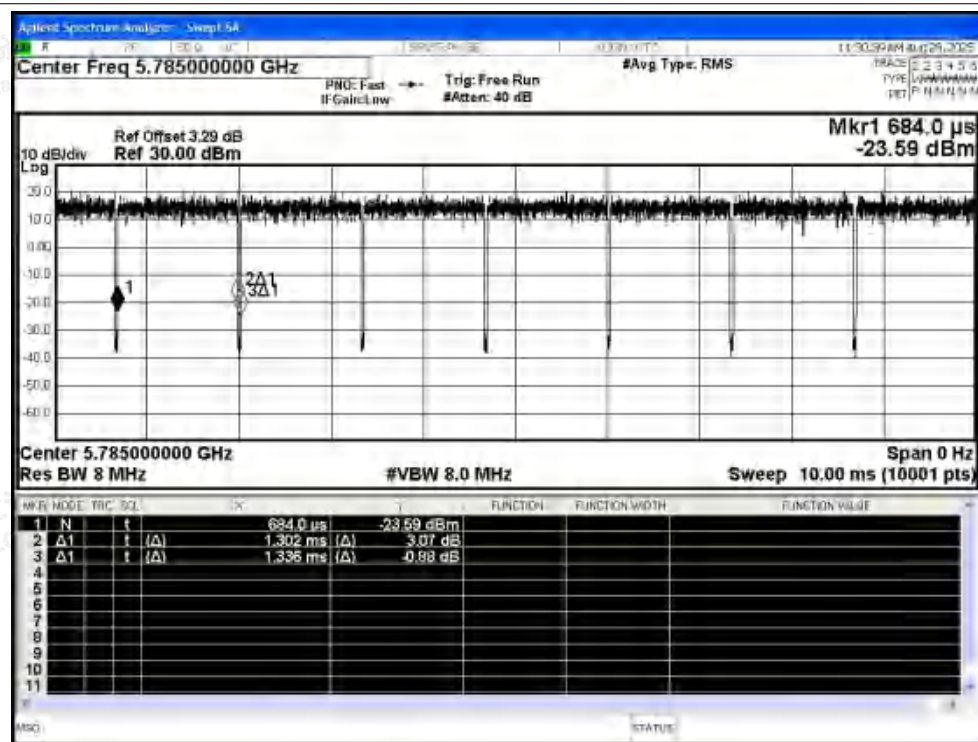

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5825MHz Ant1

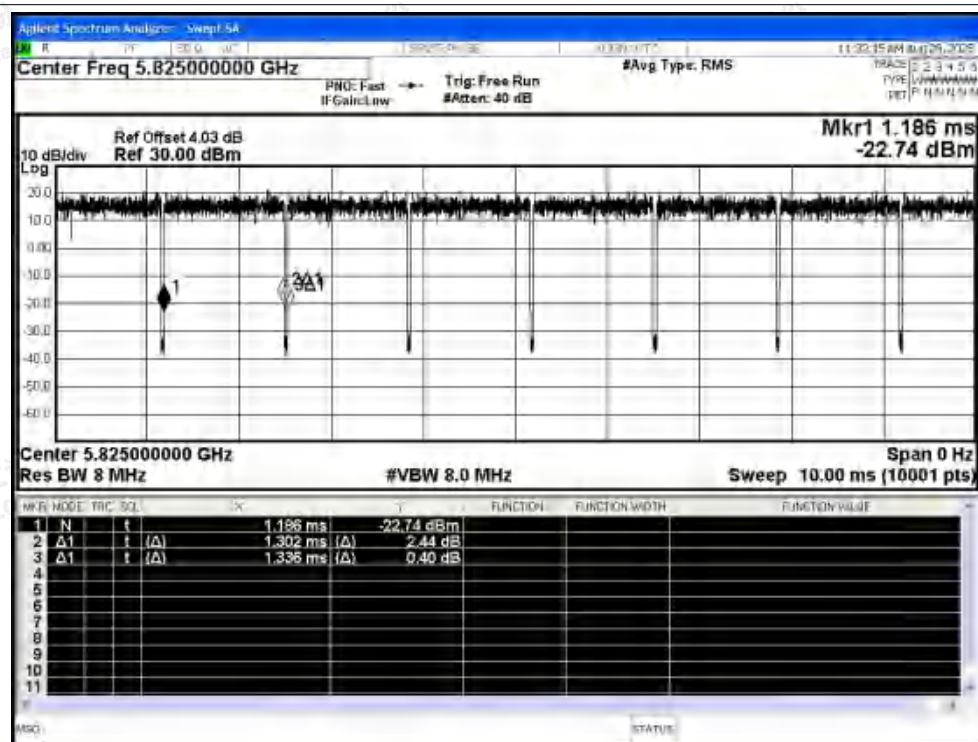

Duty Cycle NVNT ac40 5755MHz Ant1

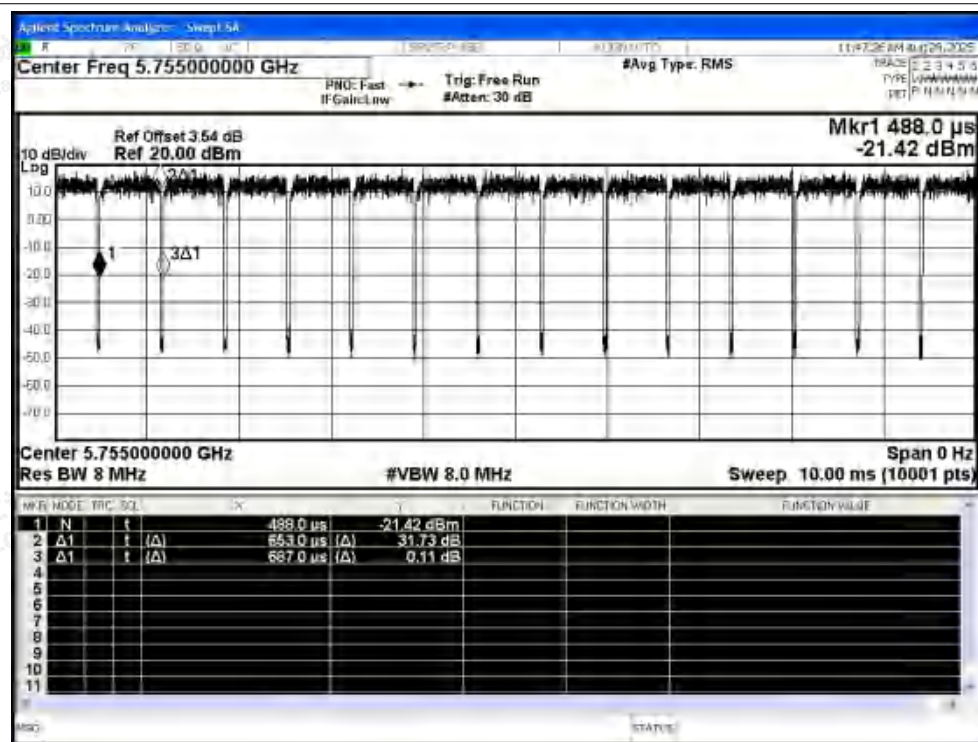

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5795MHz Ant1

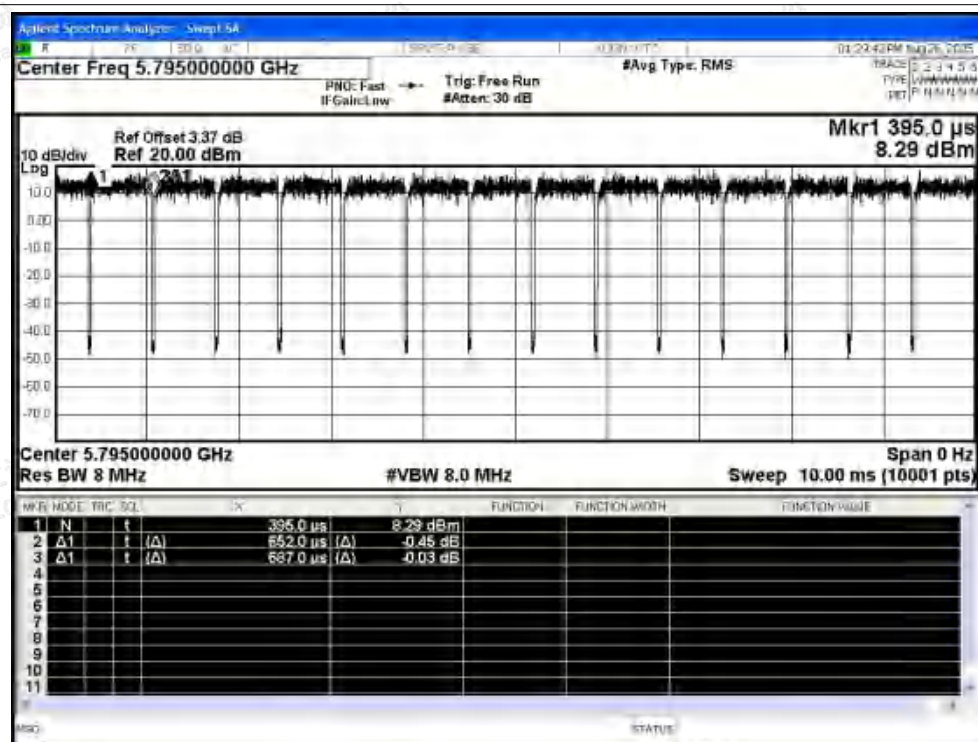

Duty Cycle NVNT ac80 5775MHz Ant1

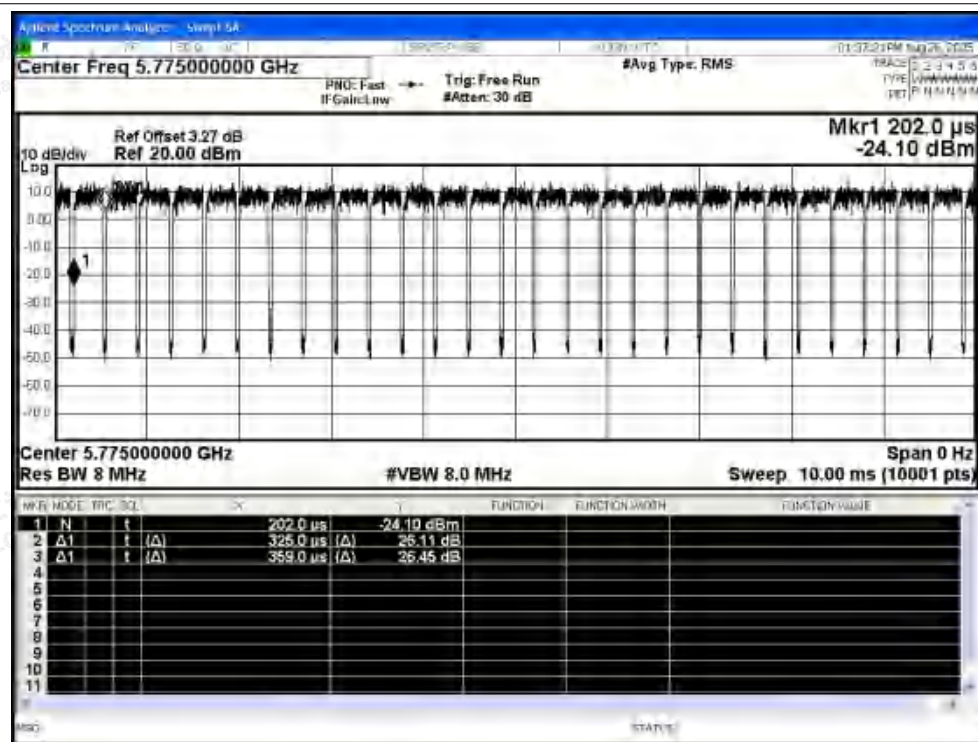

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5745MHz Ant1

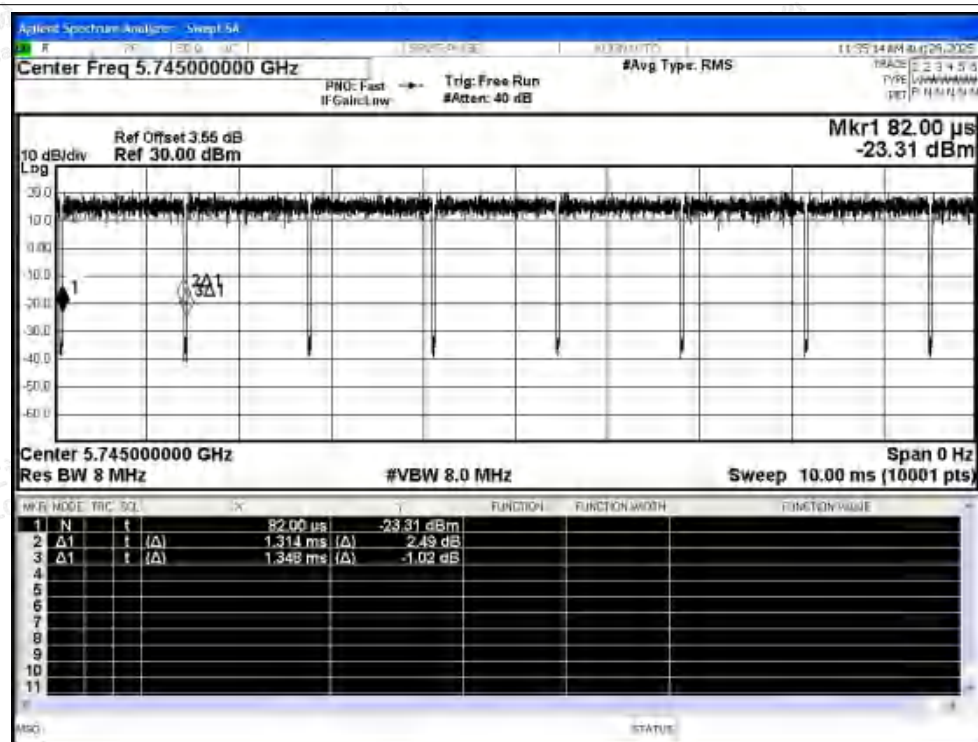

Duty Cycle NVNT ax20 5785MHz Ant1

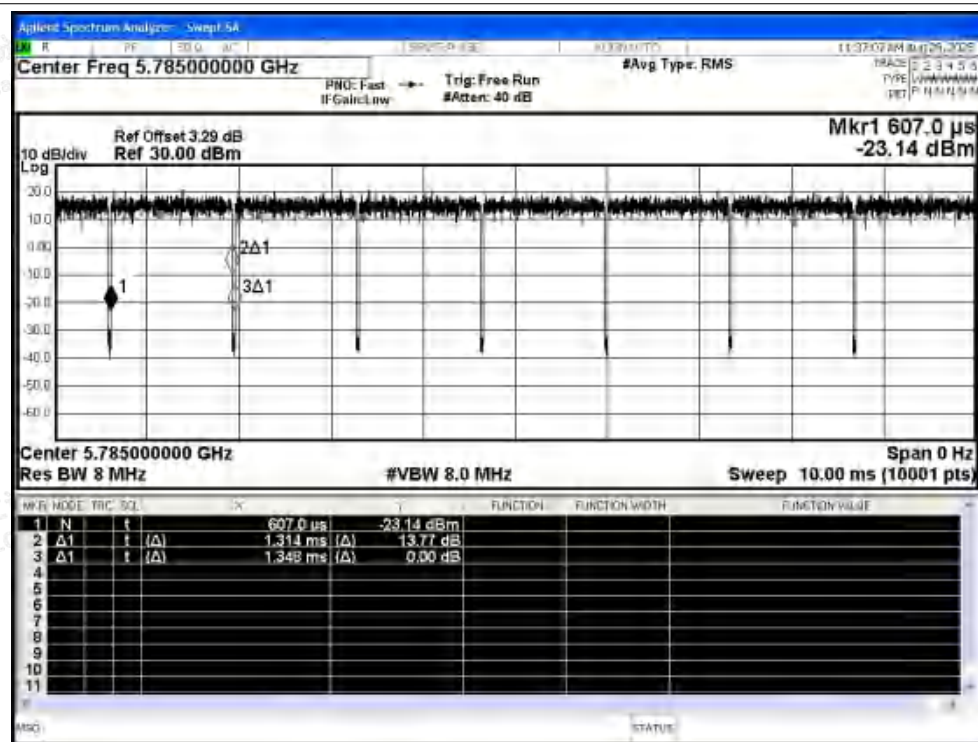

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5825MHz Ant1

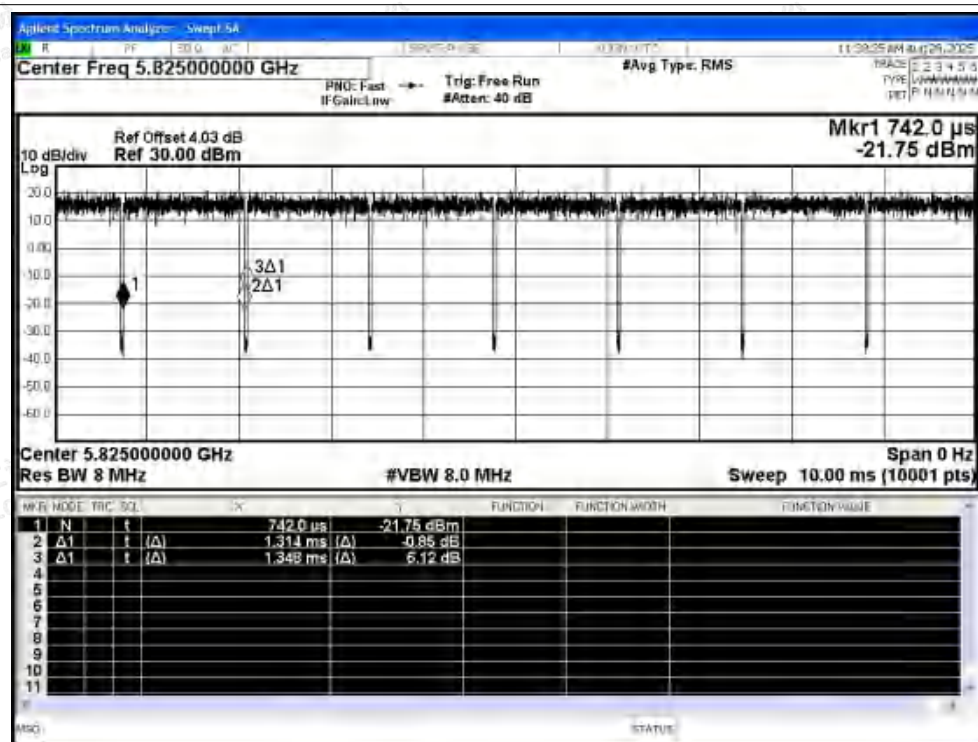

Duty Cycle NVNT ax40 5755MHz Ant1

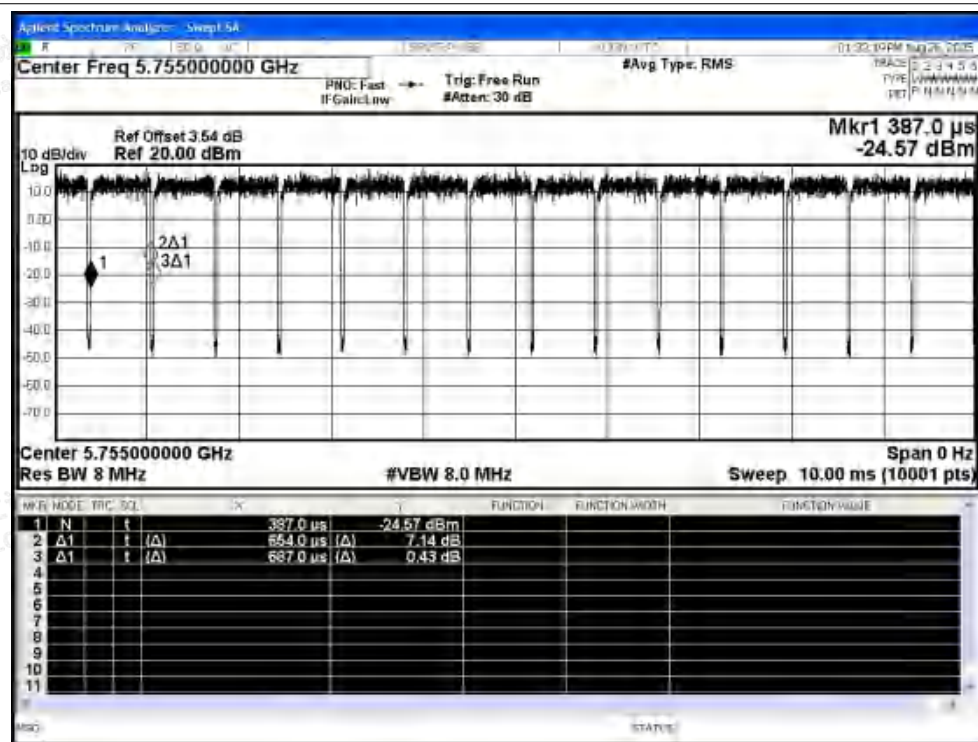

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5795MHz Ant1

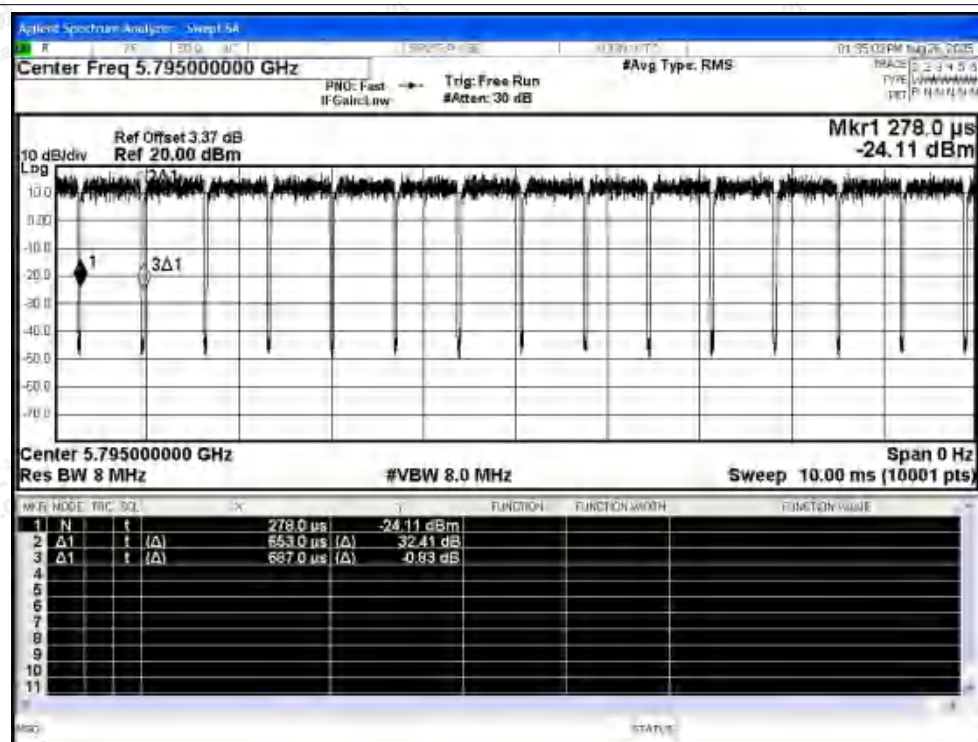

Duty Cycle NVNT ax80 5775MHz Ant1

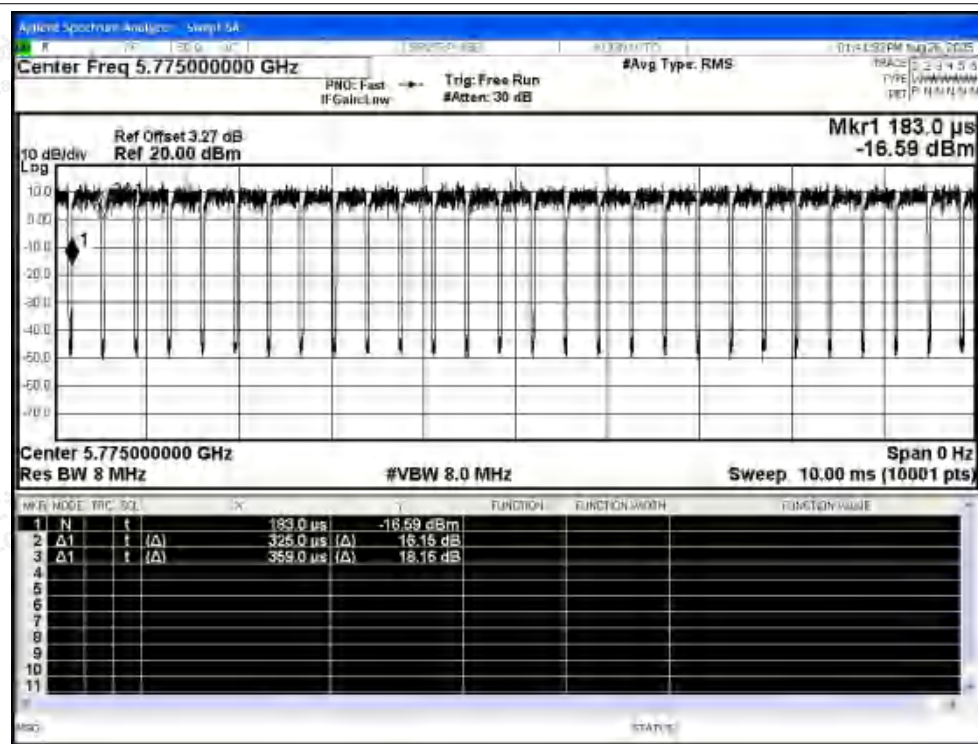


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant2	97.62	0.1	0.72
NVNT	a	5785	Ant2	97.62	0.1	0.72
NVNT	a	5825	Ant2	97.69	0.1	0.72
NVNT	n20	5745	Ant2	97.46	0.11	0.77
NVNT	n20	5785	Ant2	97.53	0.11	0.77
NVNT	n20	5825	Ant2	97.46	0.11	0.77
NVNT	n40	5755	Ant2	95.02	0.22	1.54
NVNT	n40	5795	Ant2	95.02	0.22	1.54
NVNT	ac20	5745	Ant2	97.48	0.11	0.76
NVNT	ac20	5785	Ant2	97.48	0.11	0.76
NVNT	ac20	5825	Ant2	97.55	0.11	0.76
NVNT	ac40	5755	Ant2	95.2	0.21	1.53
NVNT	ac40	5795	Ant2	95.05	0.22	1.53
NVNT	ac80	5775	Ant2	90.53	0.43	3.08
NVNT	ax20	5745	Ant2	97.55	0.11	0.76
NVNT	ax20	5785	Ant2	97.48	0.11	0.76
NVNT	ax20	5825	Ant2	97.48	0.11	0.76
NVNT	ax40	5755	Ant2	95.2	0.21	1.53
NVNT	ax40	5795	Ant2	95.2	0.21	1.53
NVNT	ax80	5775	Ant2	90.53	0.43	3.08



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5745MHz Ant2

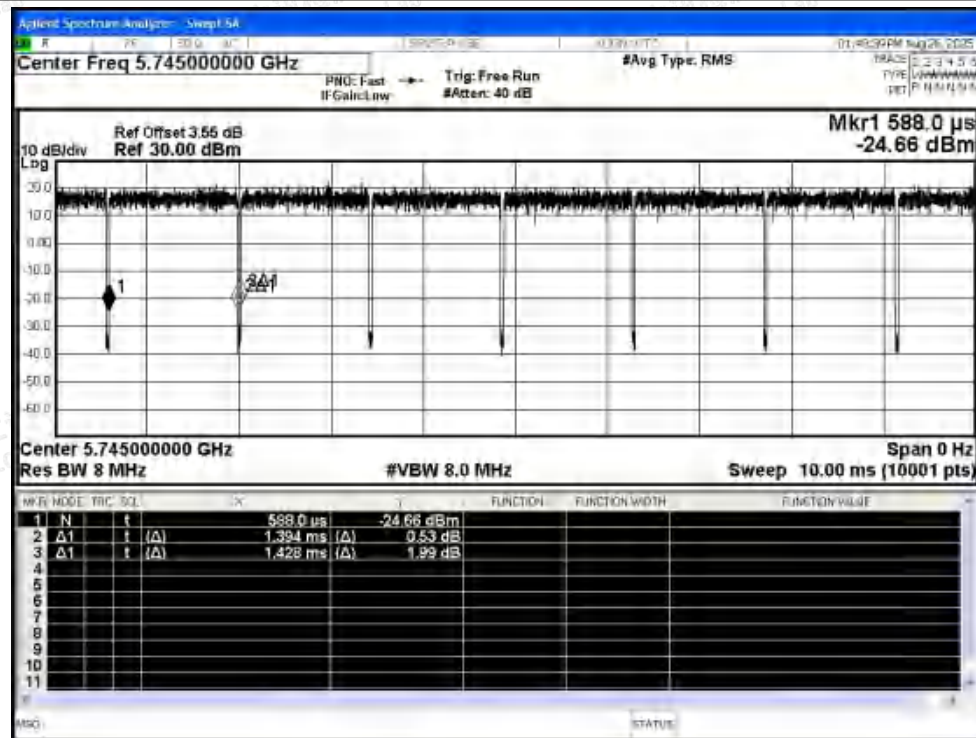

Duty Cycle NVNT a 5785MHz Ant2

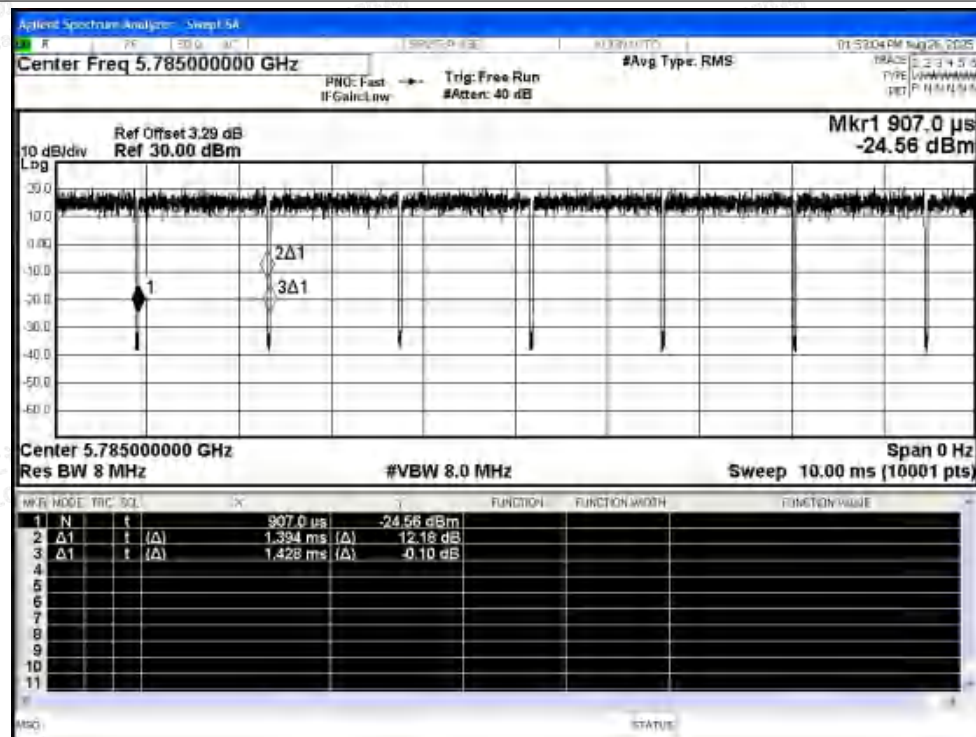

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5825MHz Ant2

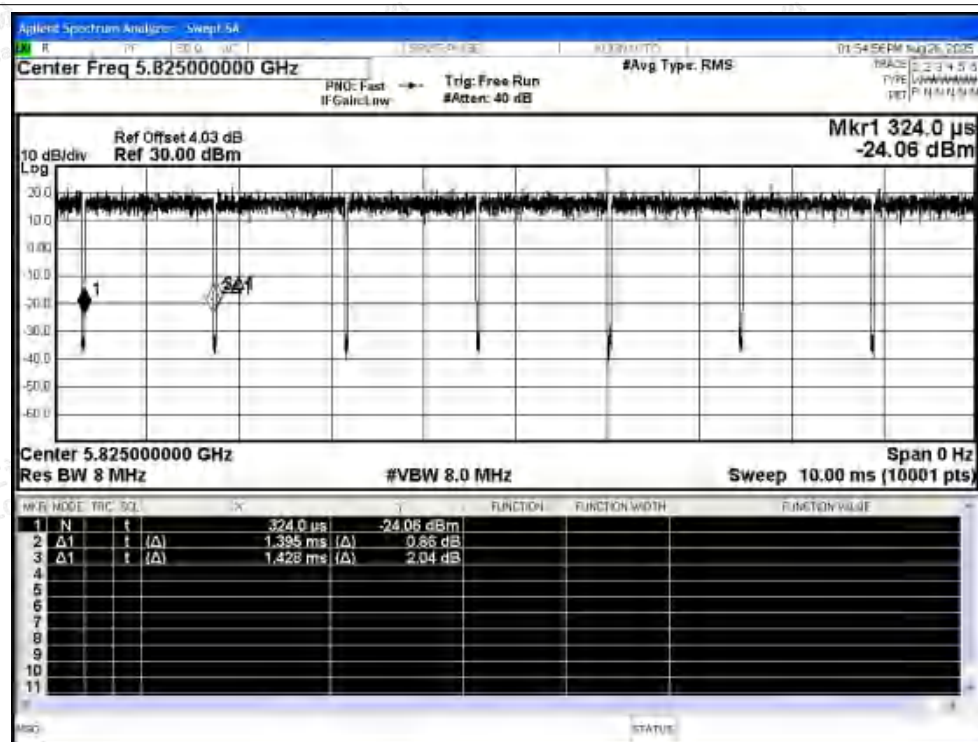

Duty Cycle NVNT n20 5745MHz Ant2

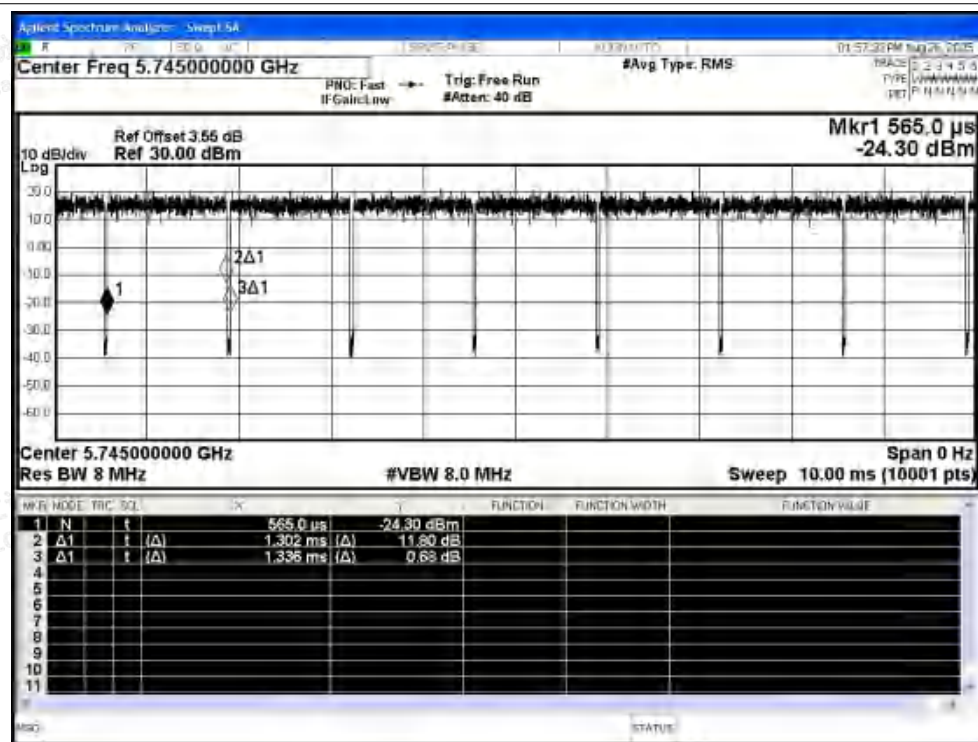

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5785MHz Ant2

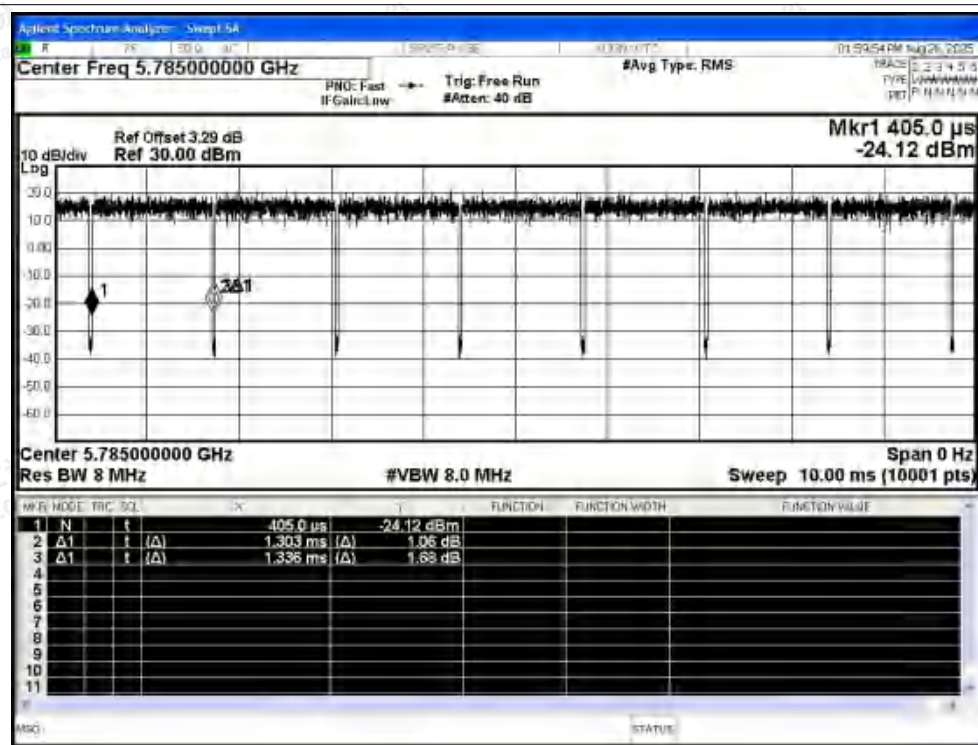

Duty Cycle NVNT n20 5825MHz Ant2

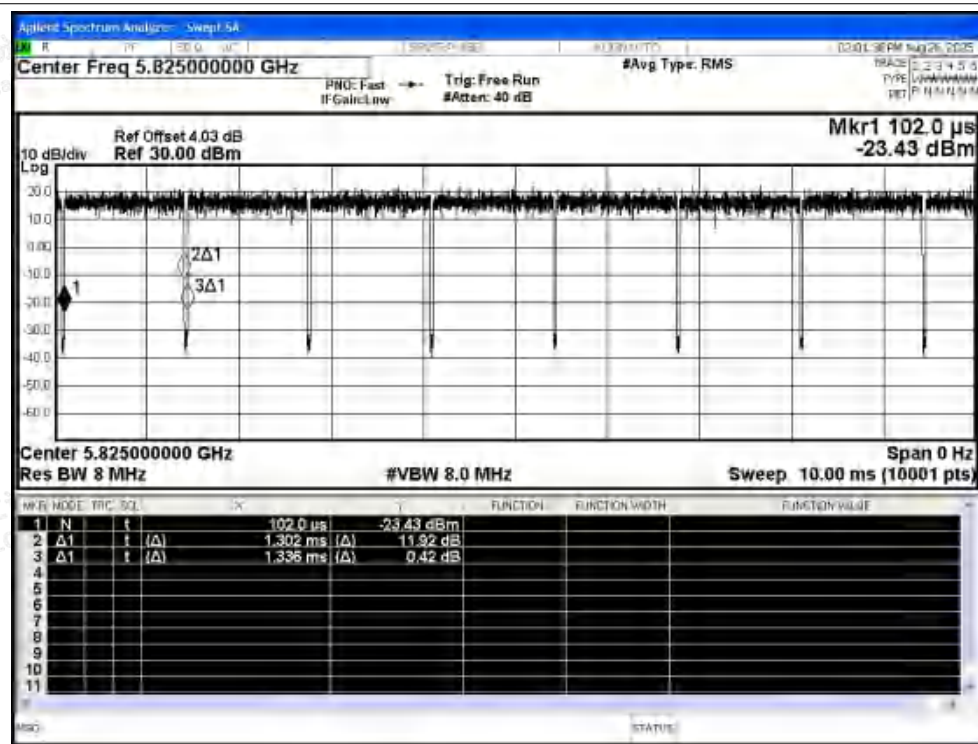

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5755MHz Ant2

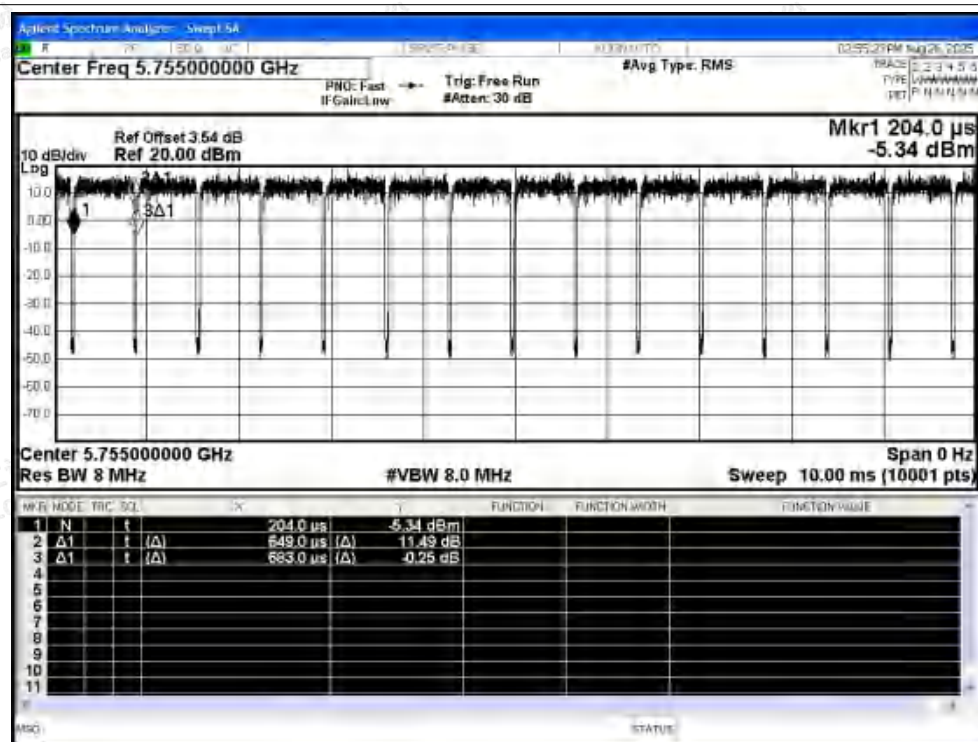


Duty Cycle NVNT n40 5795MHz Ant2

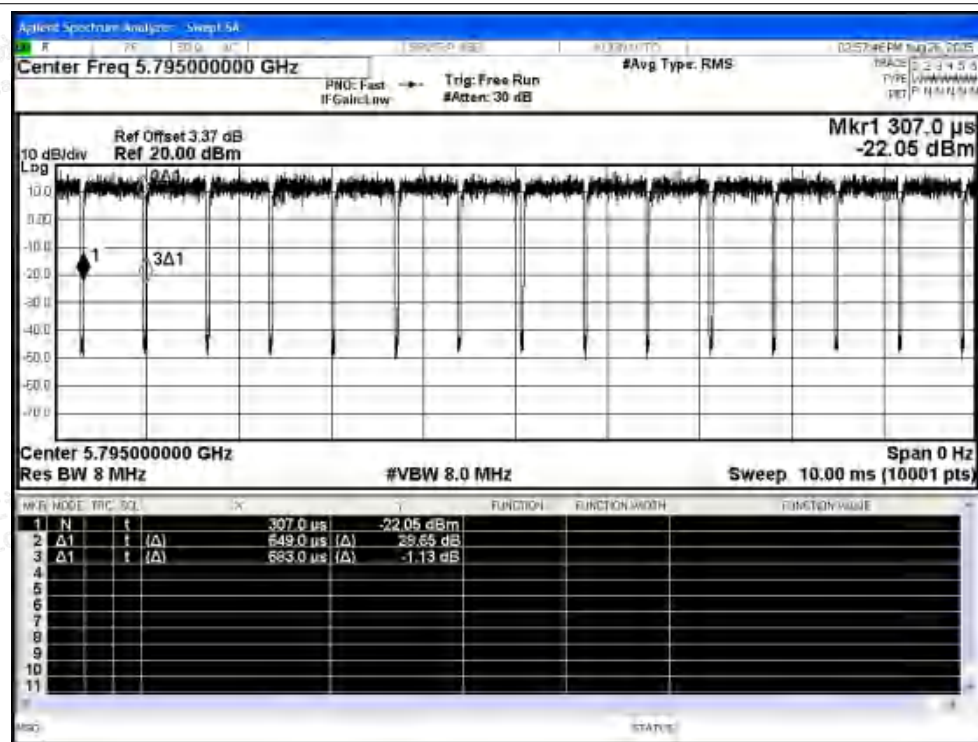





Duty Cycle NVNT ac20 5745MHz Ant2

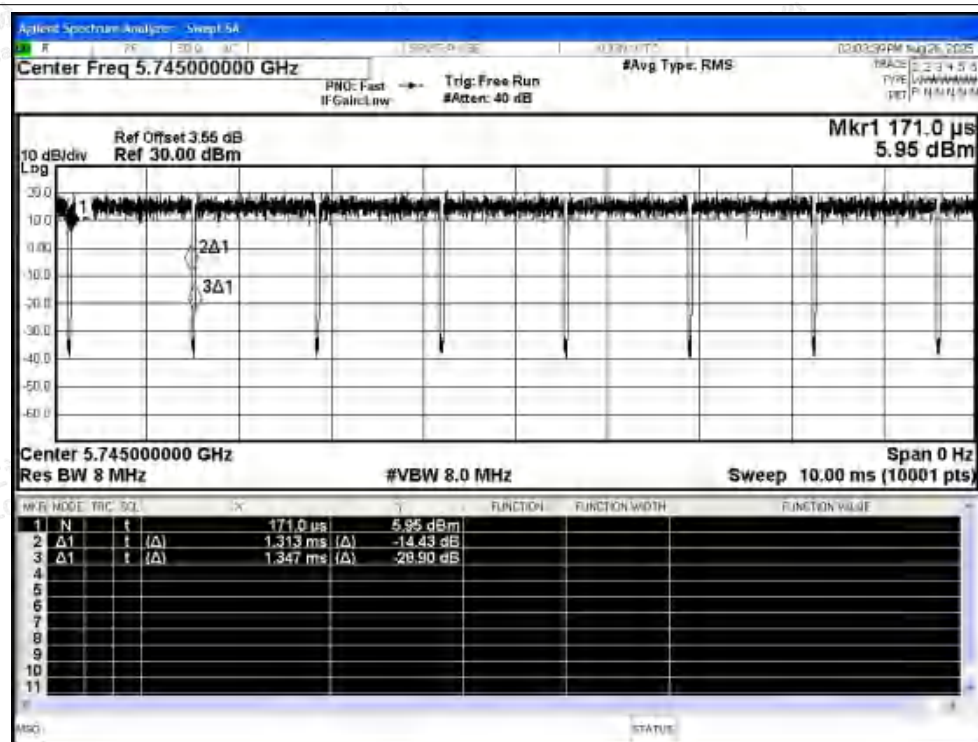


Duty Cycle NVNT ac20 5785MHz Ant2

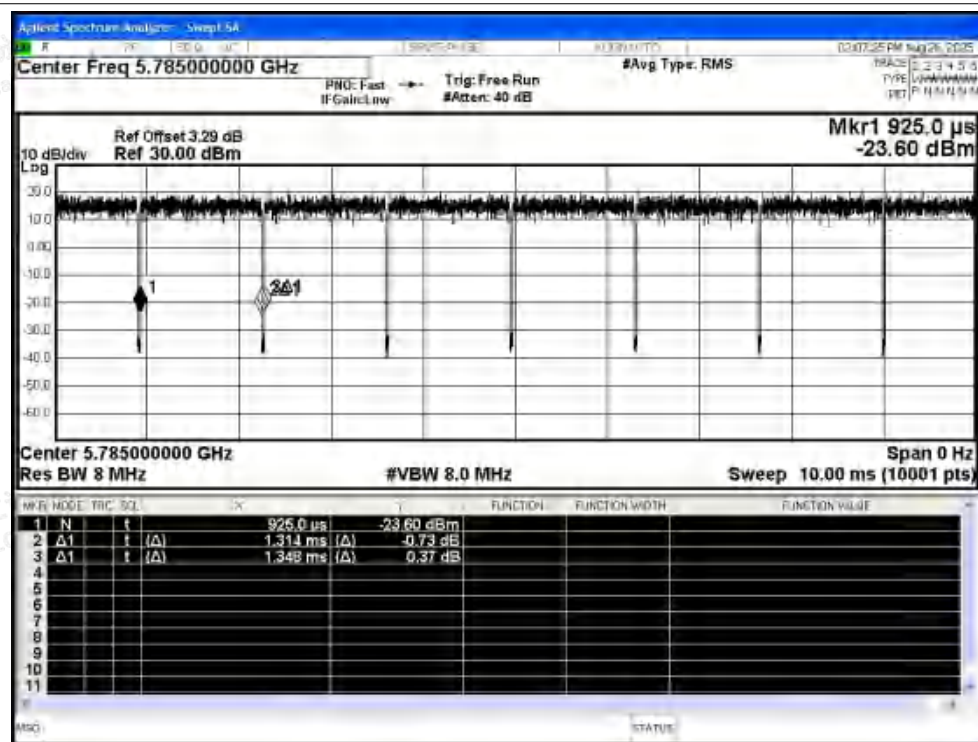




Duty Cycle NVNT ac20 5825MHz Ant2

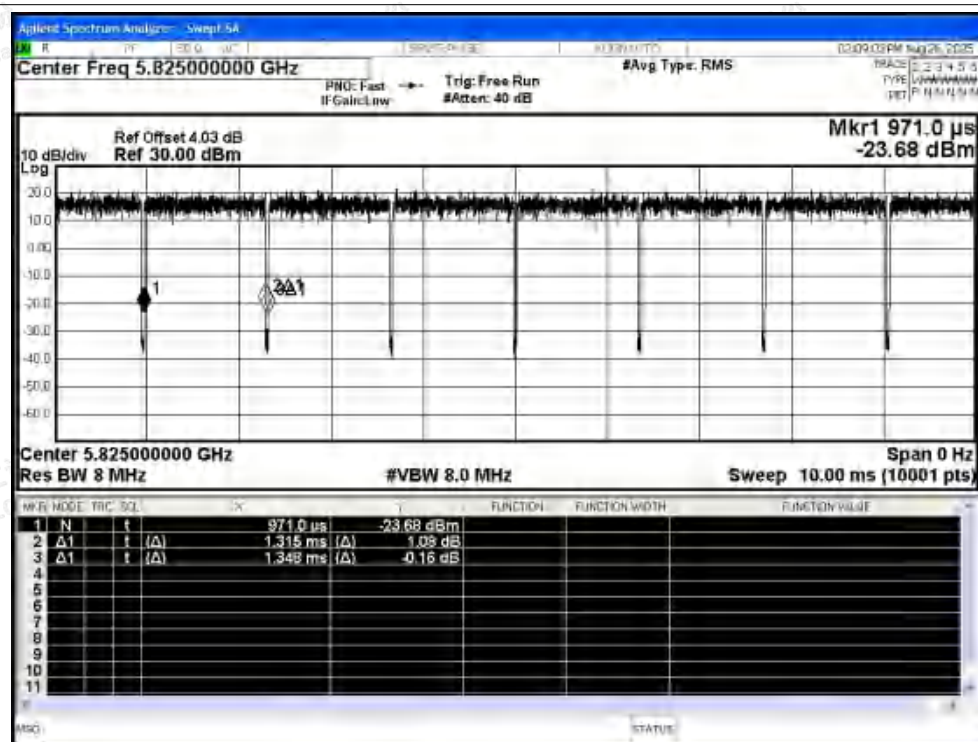

Duty Cycle NVNT ac40 5755MHz Ant2

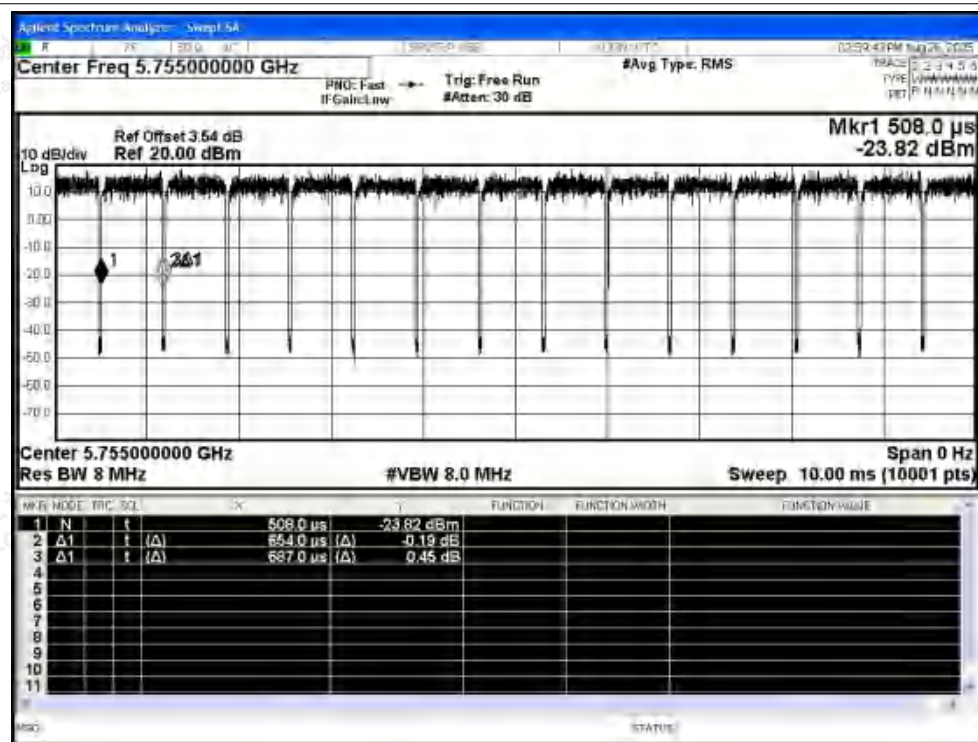


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5795MHz Ant2

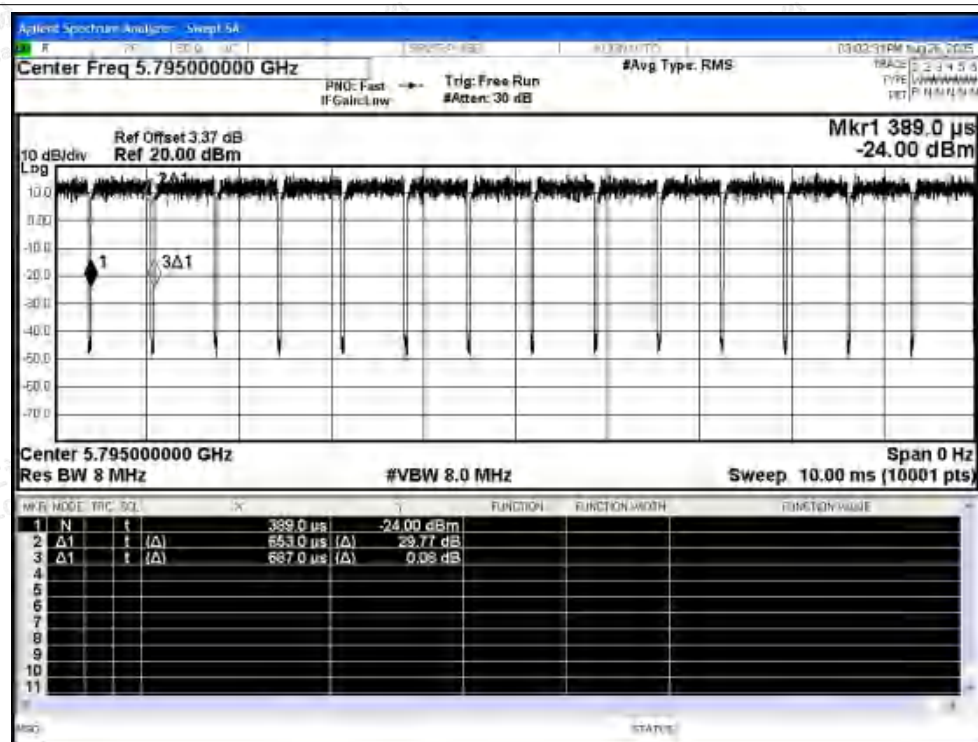

Duty Cycle NVNT ac80 5775MHz Ant2

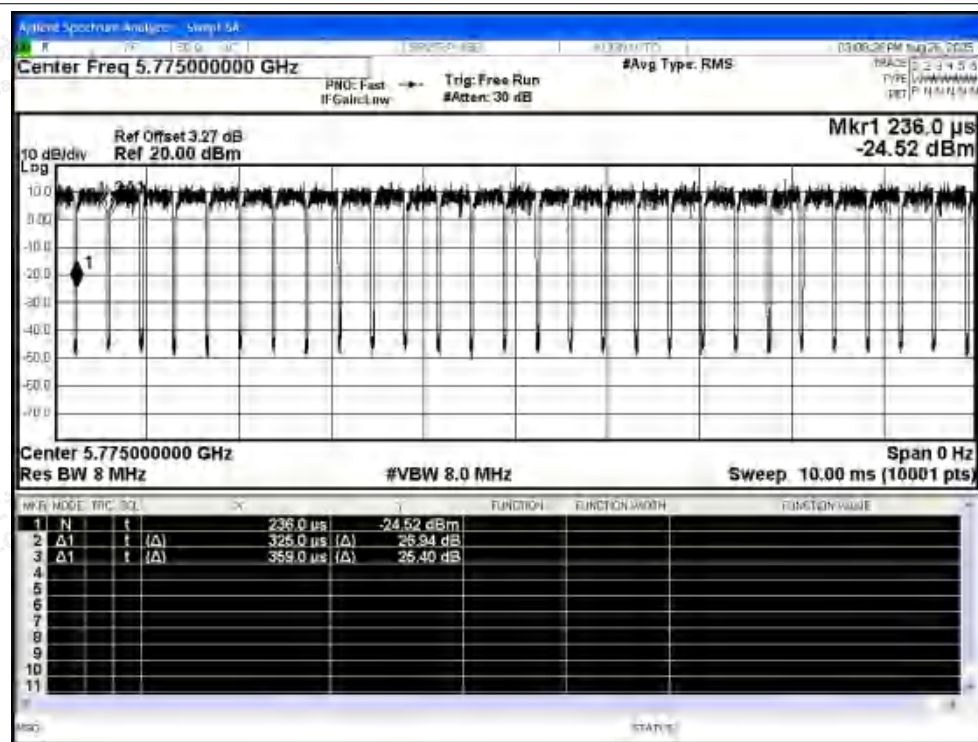


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5745MHz Ant2

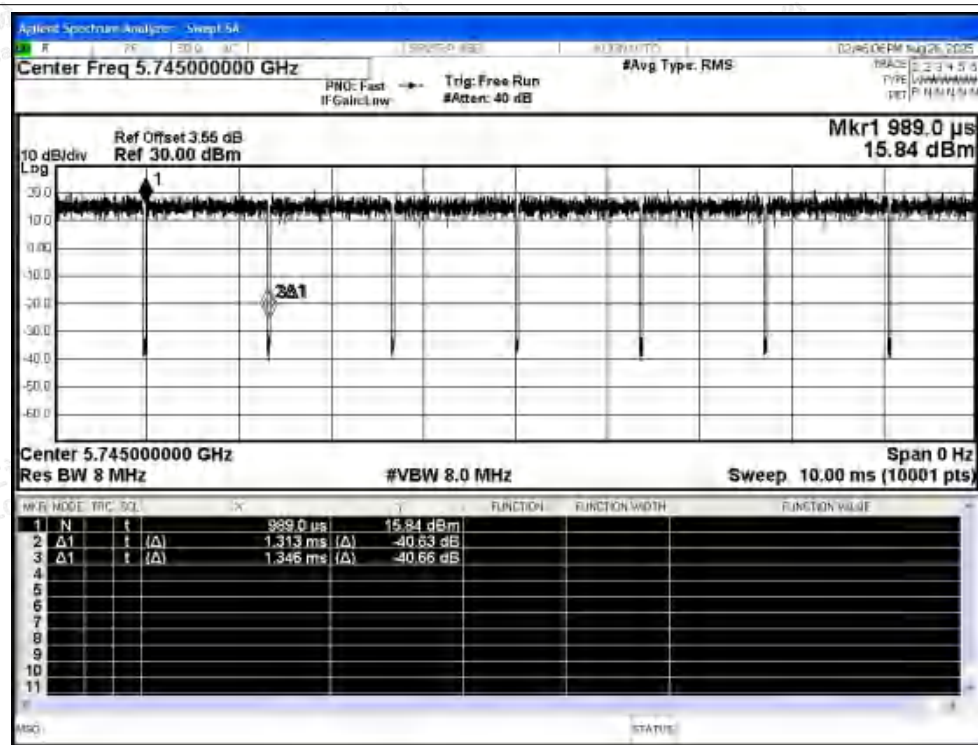

Duty Cycle NVNT ax20 5785MHz Ant2

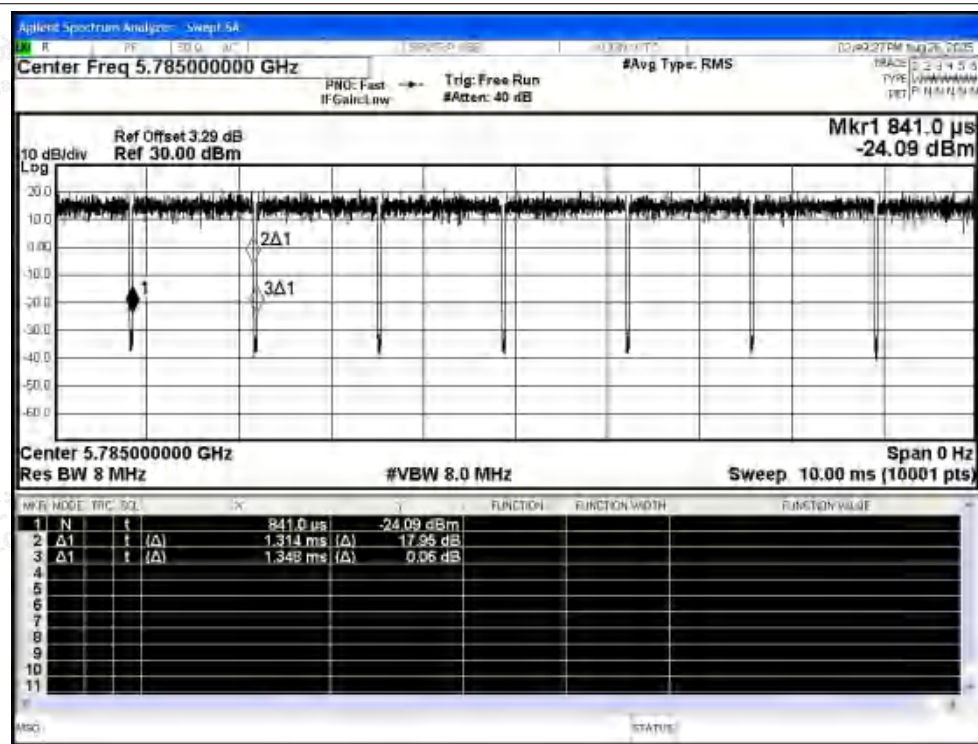

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5825MHz Ant2

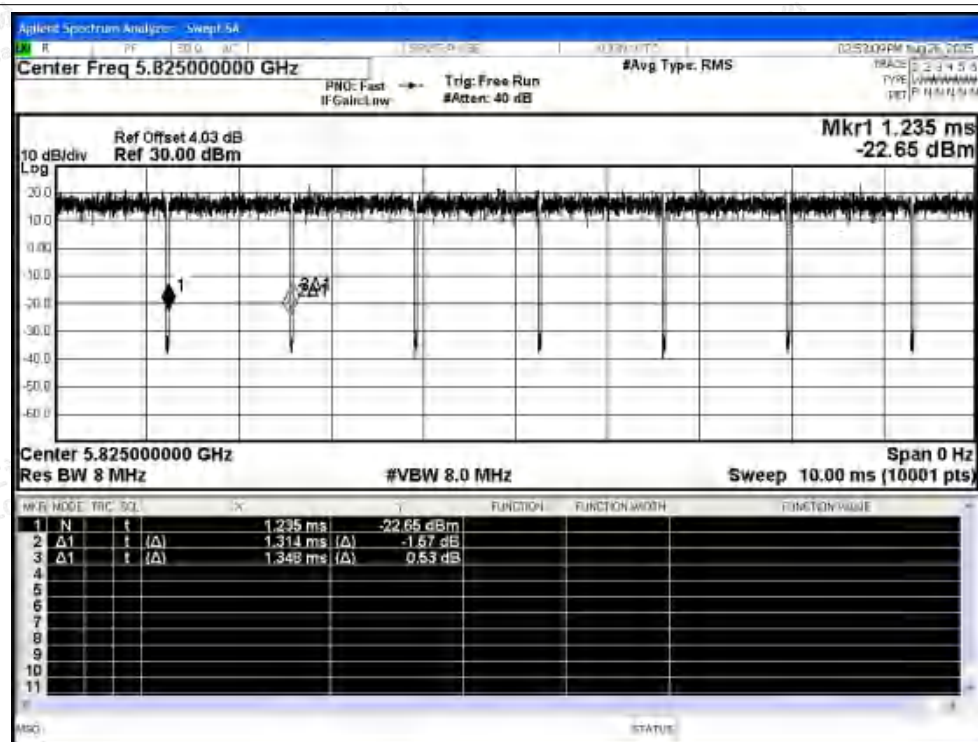

Duty Cycle NVNT ax40 5755MHz Ant2

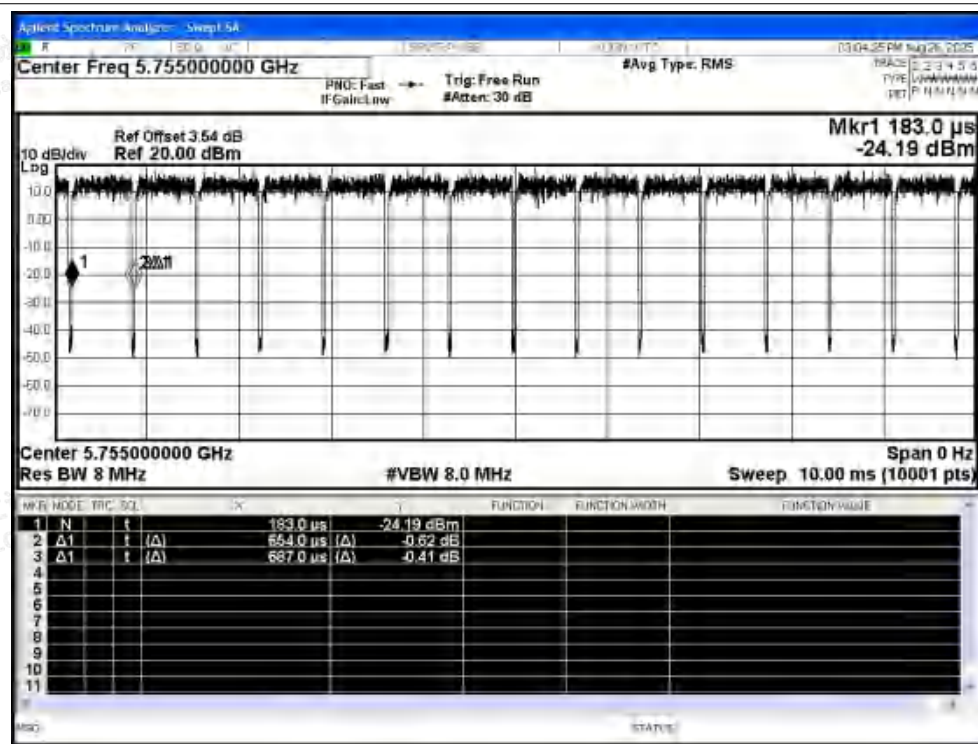

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5795MHz Ant2

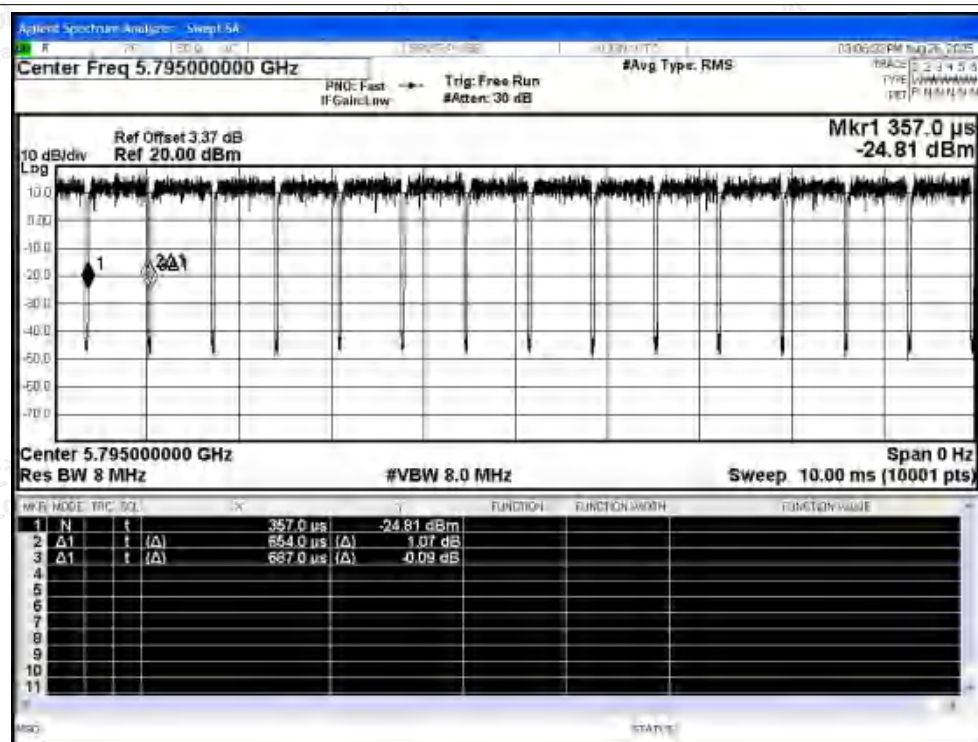

Duty Cycle NVNT ax80 5775MHz Ant2

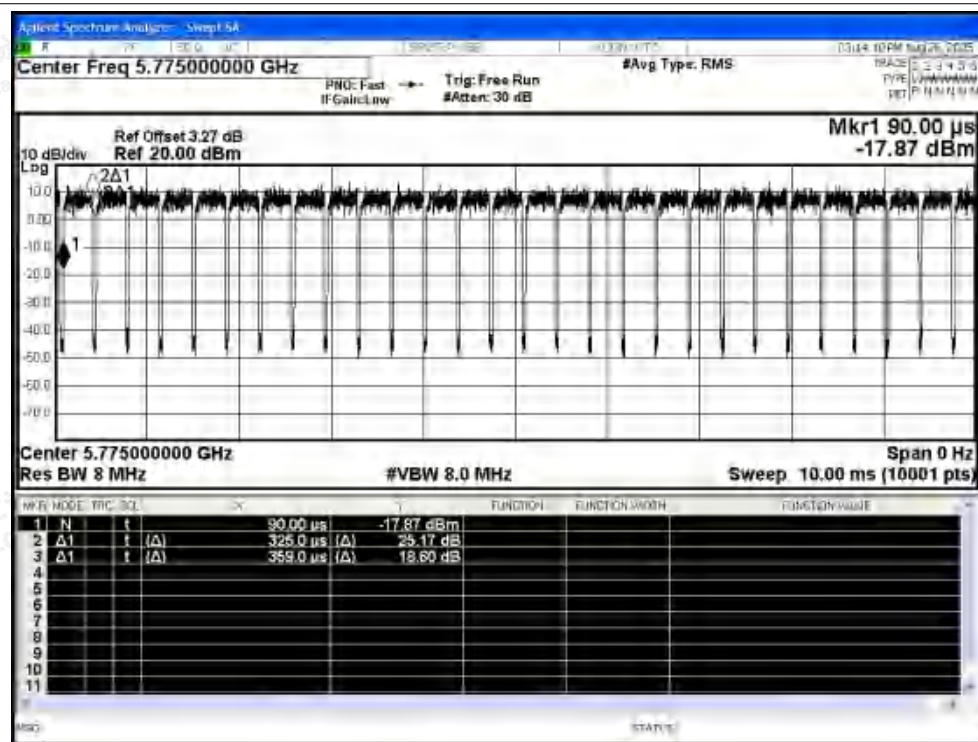

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity