




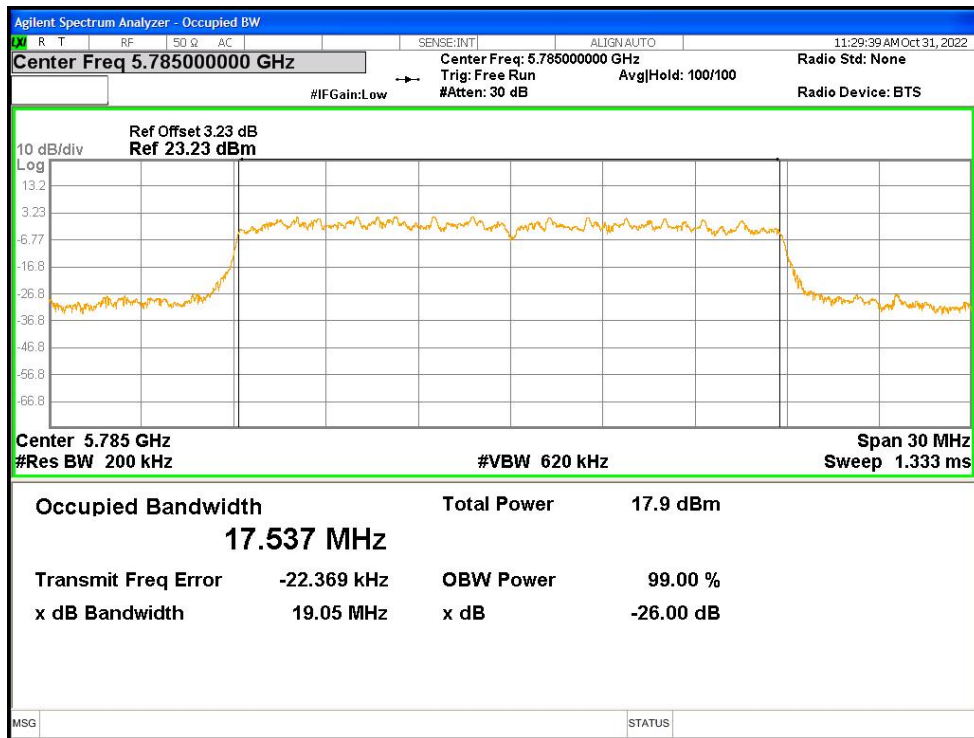


OBW NVNT n20 5825MHz Ant1

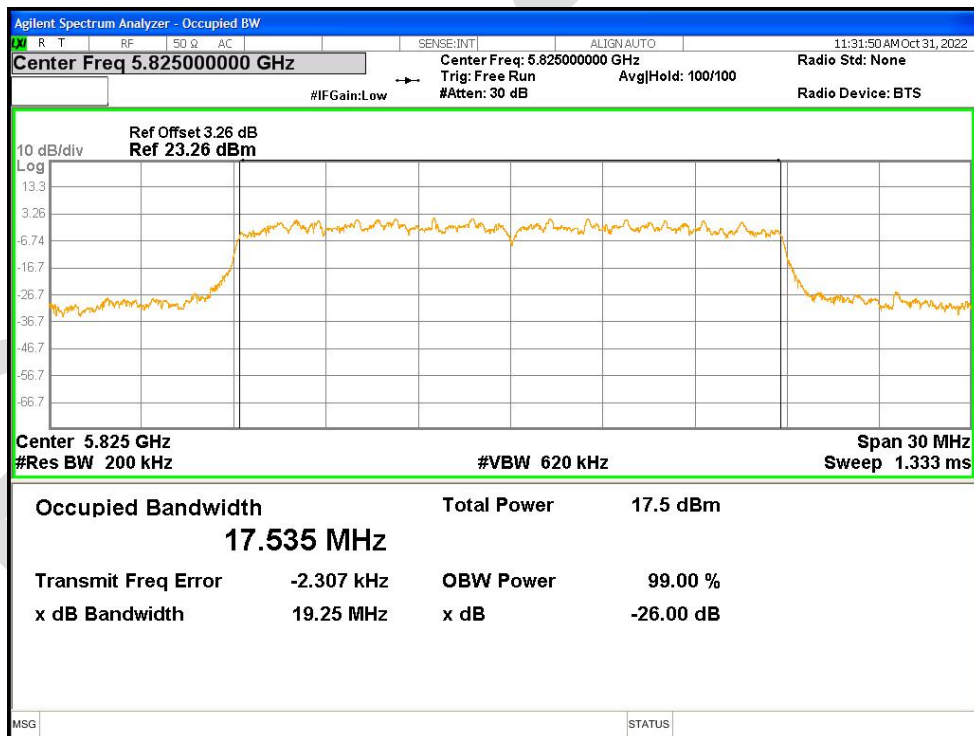


OBW NVNT n20 5180MHz Ant2

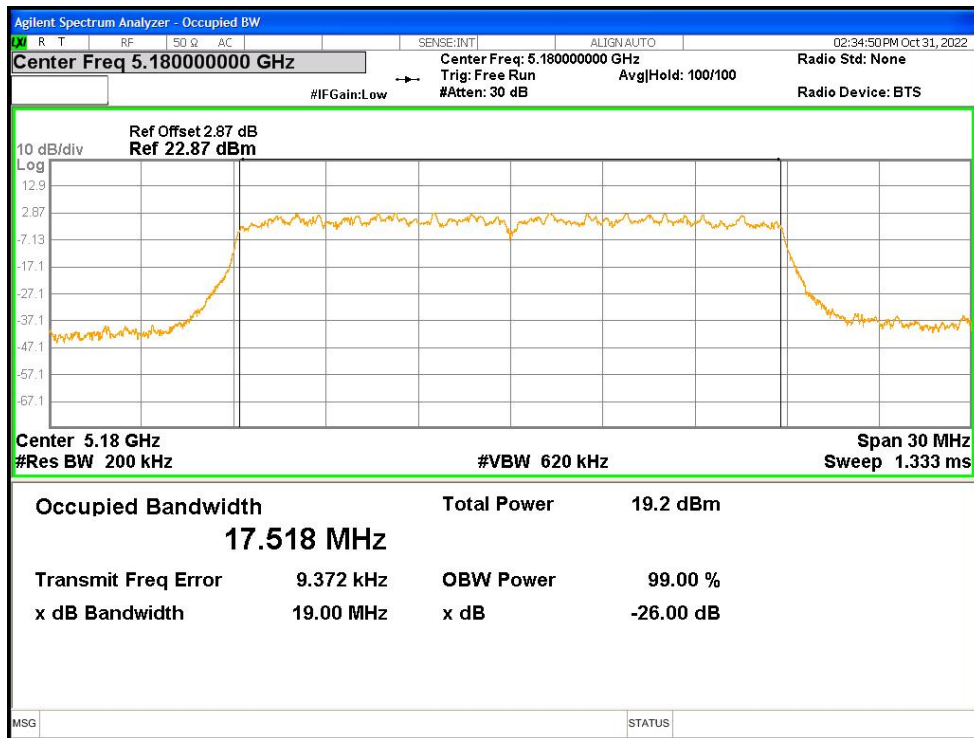


OBW NVNT n20 5200MHz Ant2

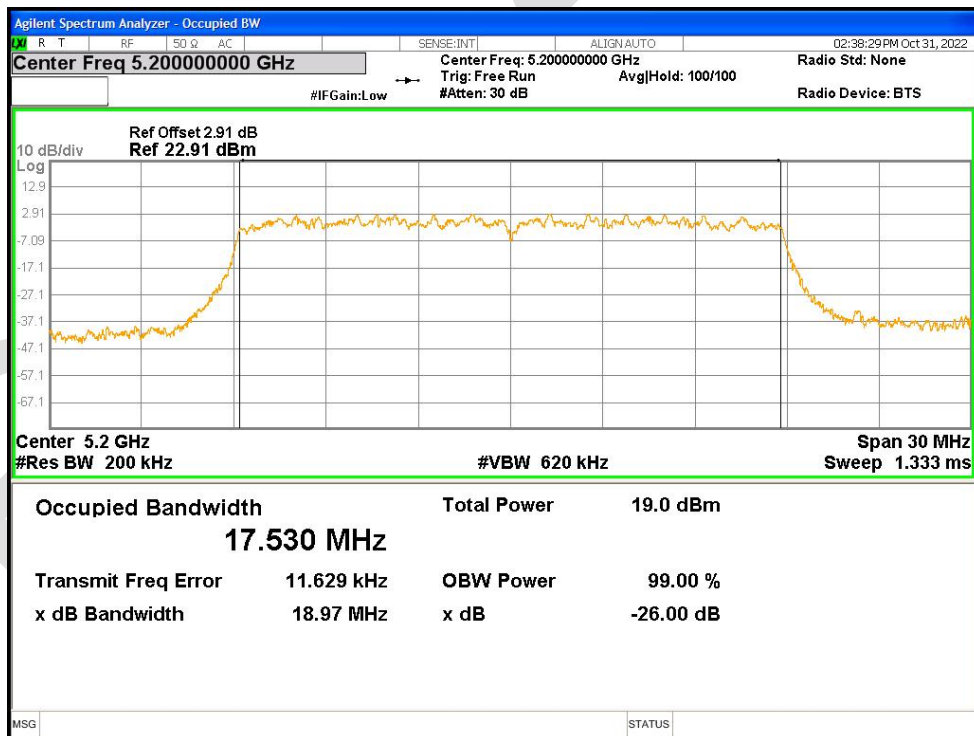


OBW NVNT n20 5240MHz Ant2

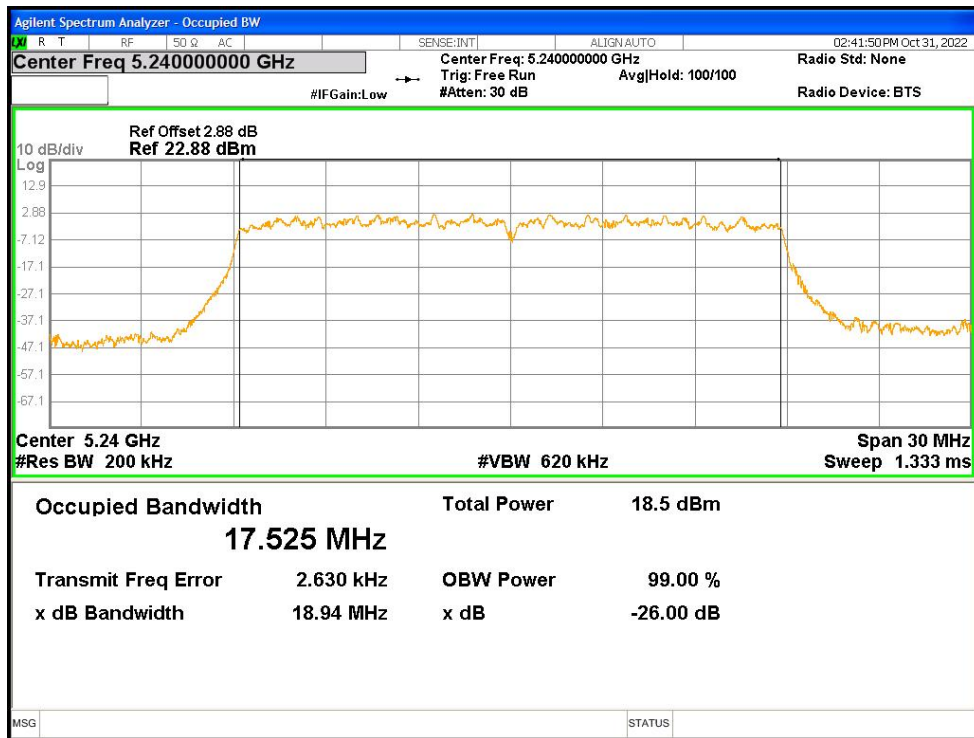


OBW NVNT n20 5260MHz Ant2

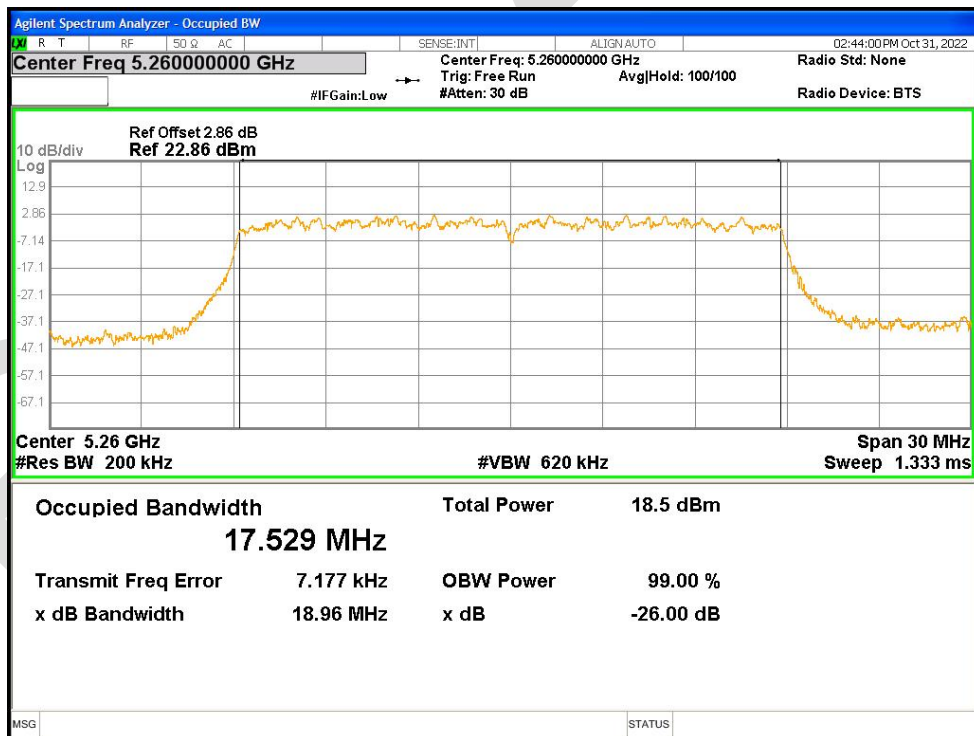


OBW NVNT n20 5280MHz Ant2

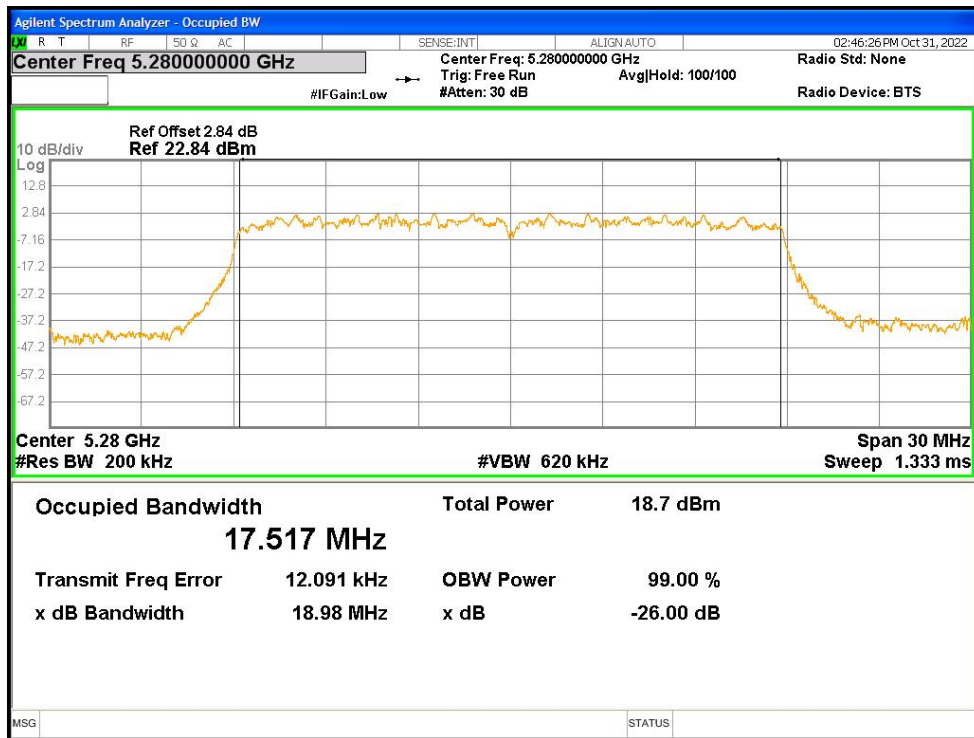


OBW NVNT n20 5320MHz Ant2

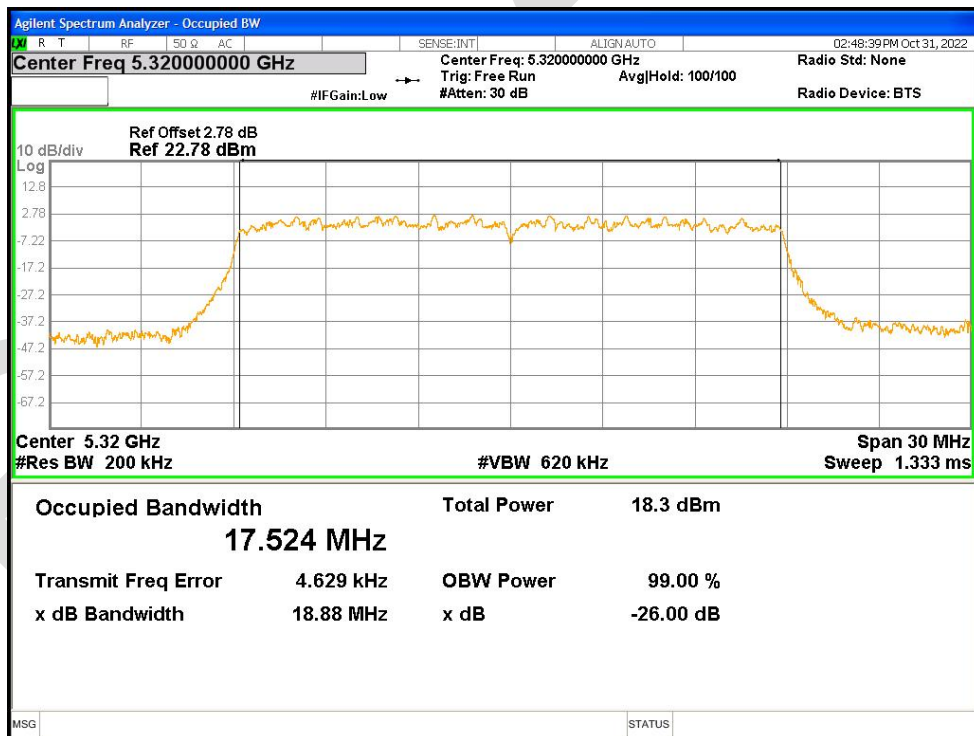


OBW NVNT n20 5500MHz Ant2

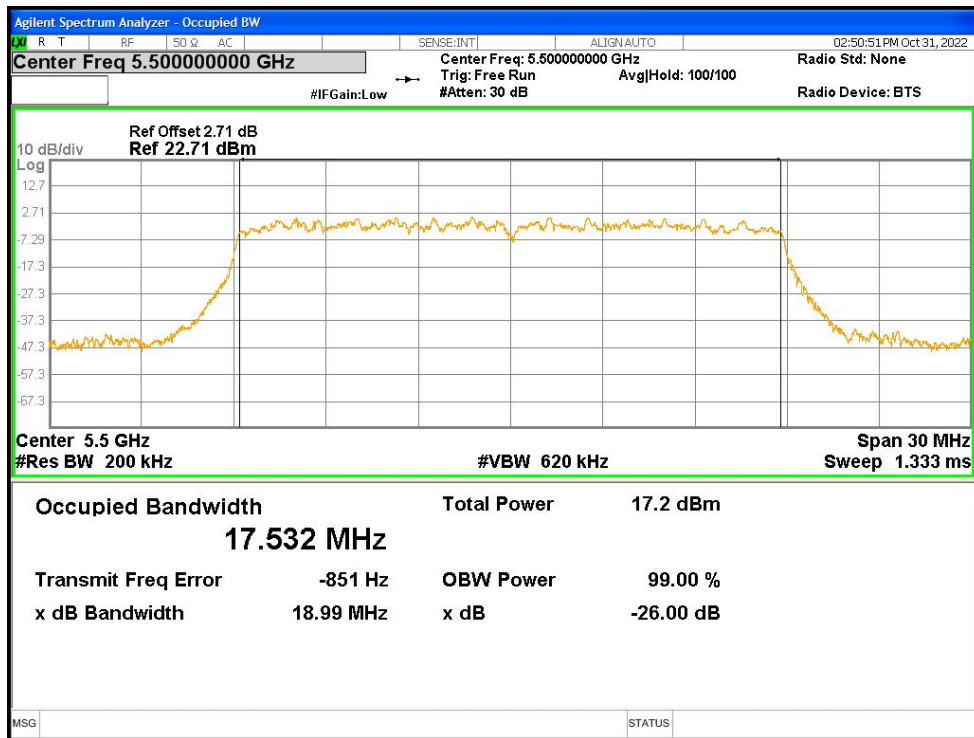


OBW NVNT n20 5600MHz Ant2

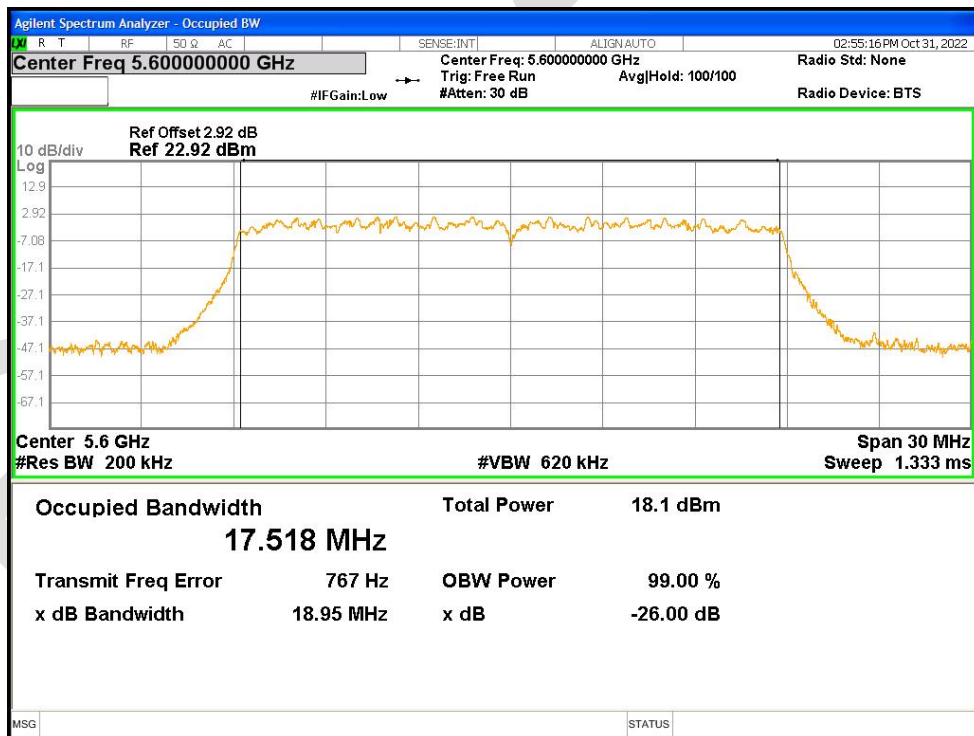


OBW NVNT n20 5700MHz Ant2

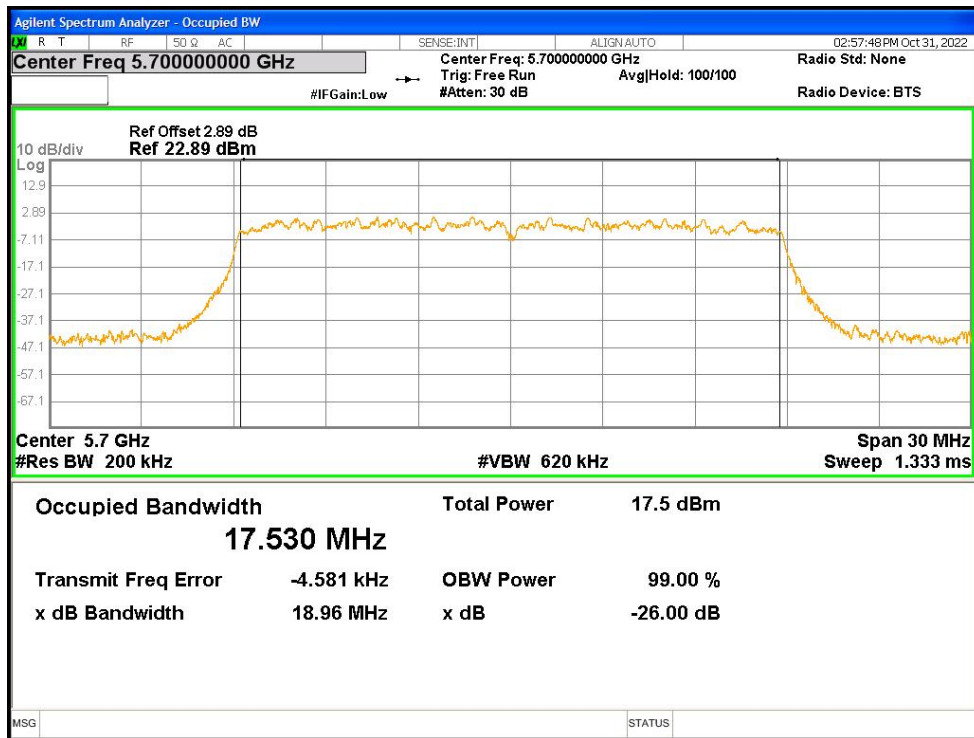


OBW NVNT n20 5745MHz Ant2

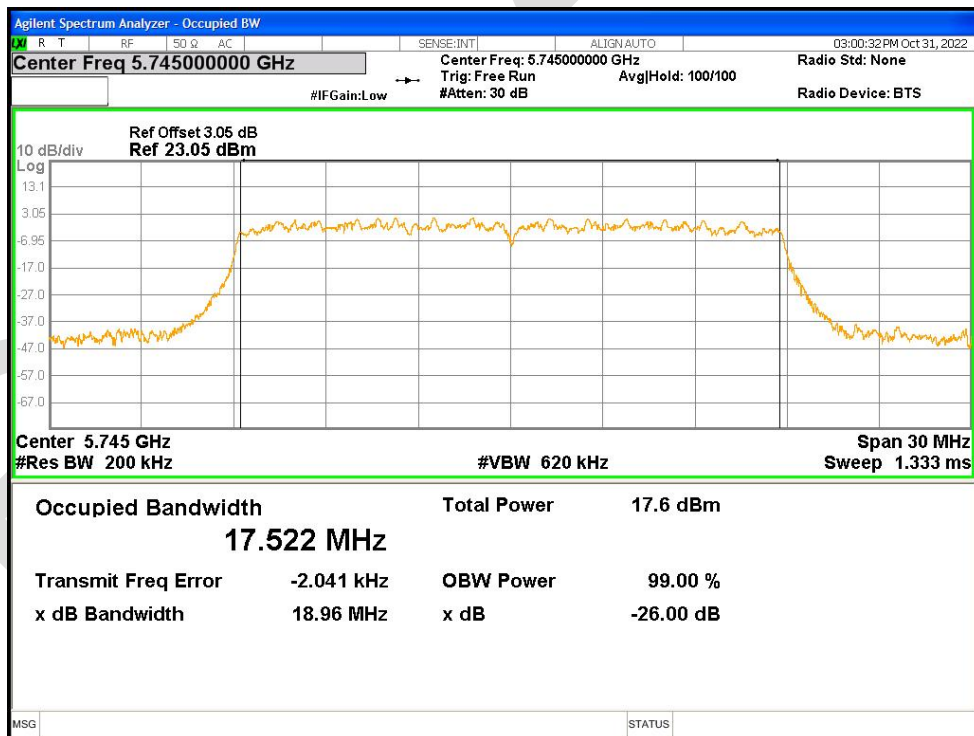


OBW NVNT n20 5785MHz Ant2

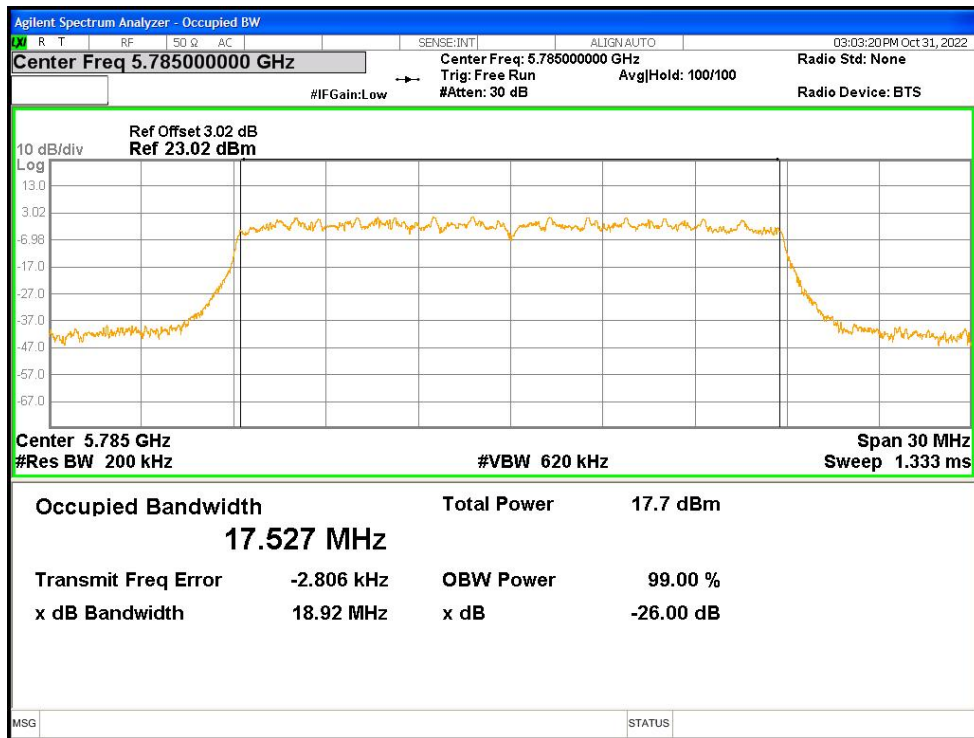


OBW NVNT n20 5825MHz Ant2

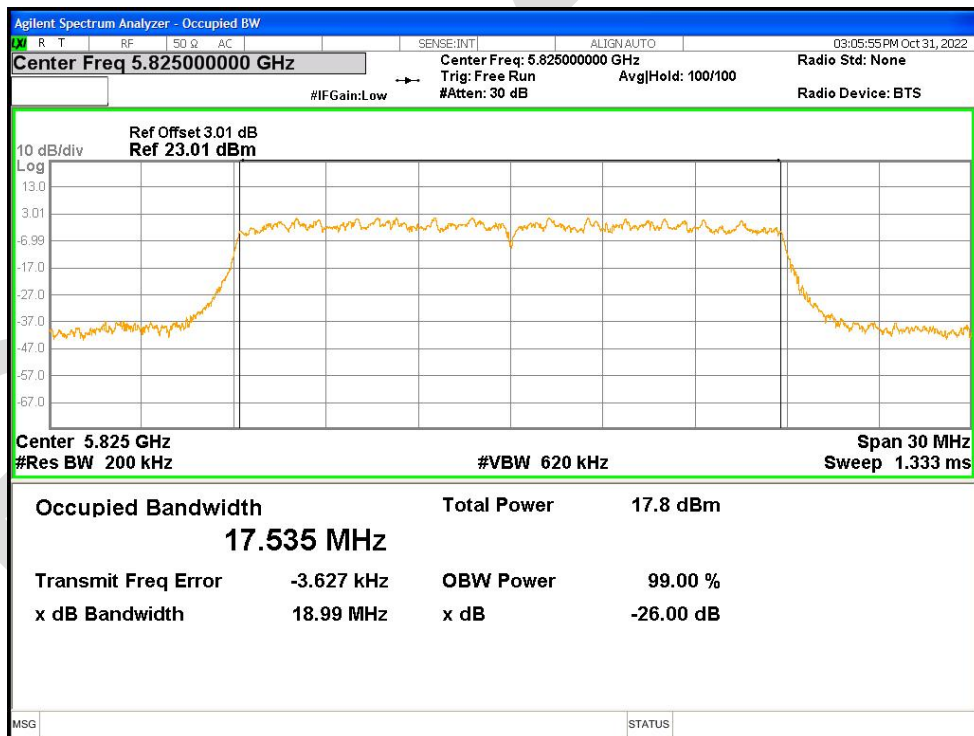


OBW NVNT n40 5190MHz Ant1

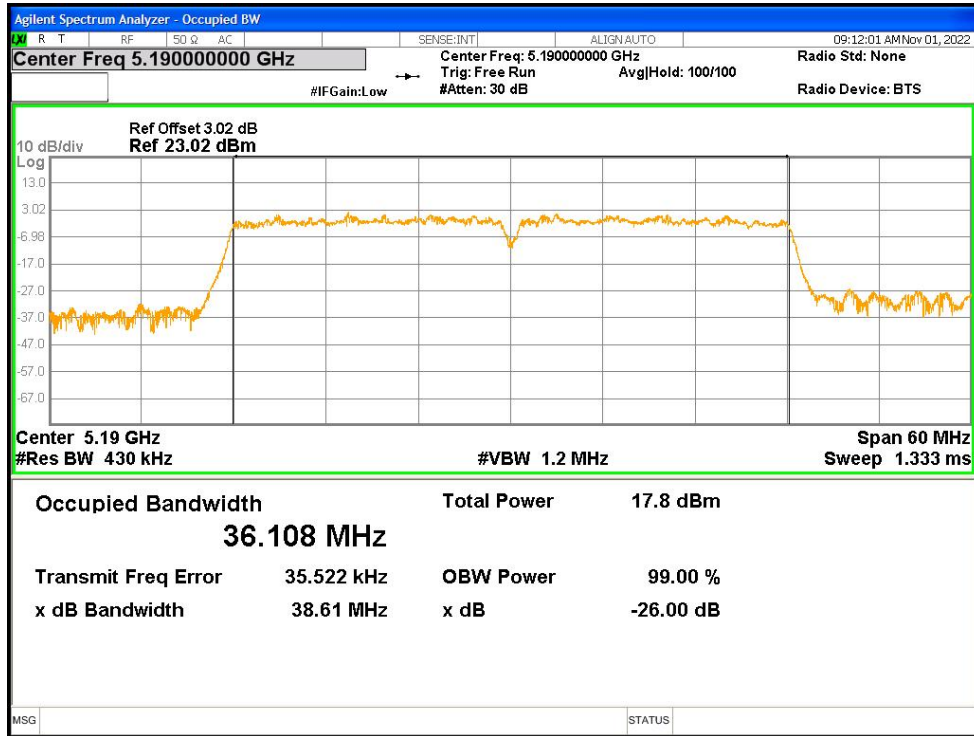


OBW NVNT n40 5230MHz Ant1

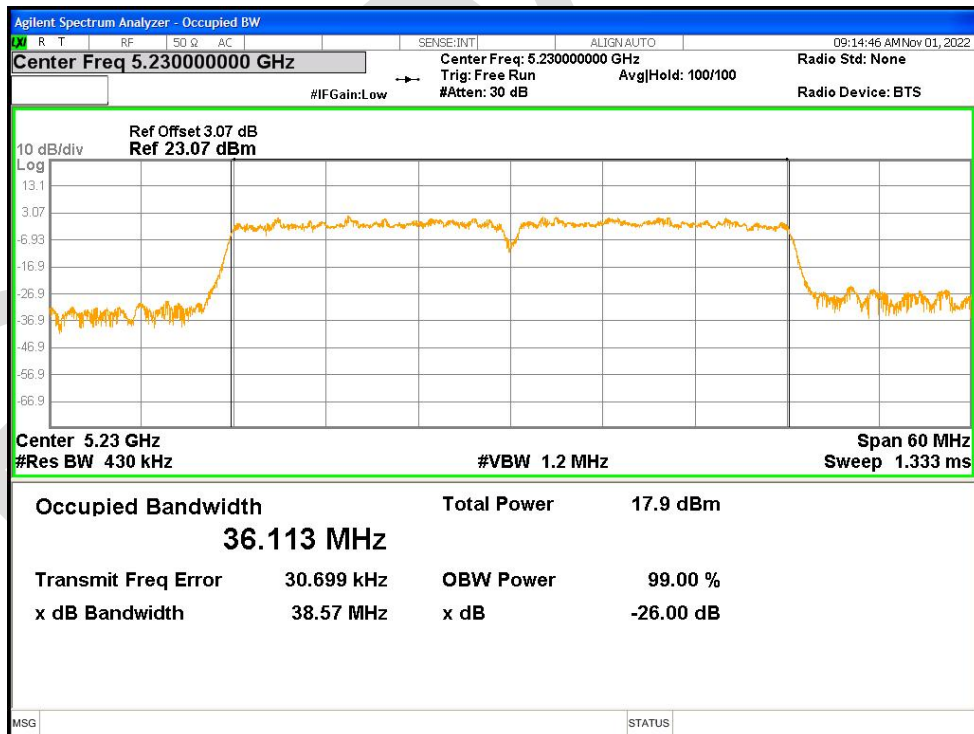


OBW NVNT n40 5270MHz Ant1

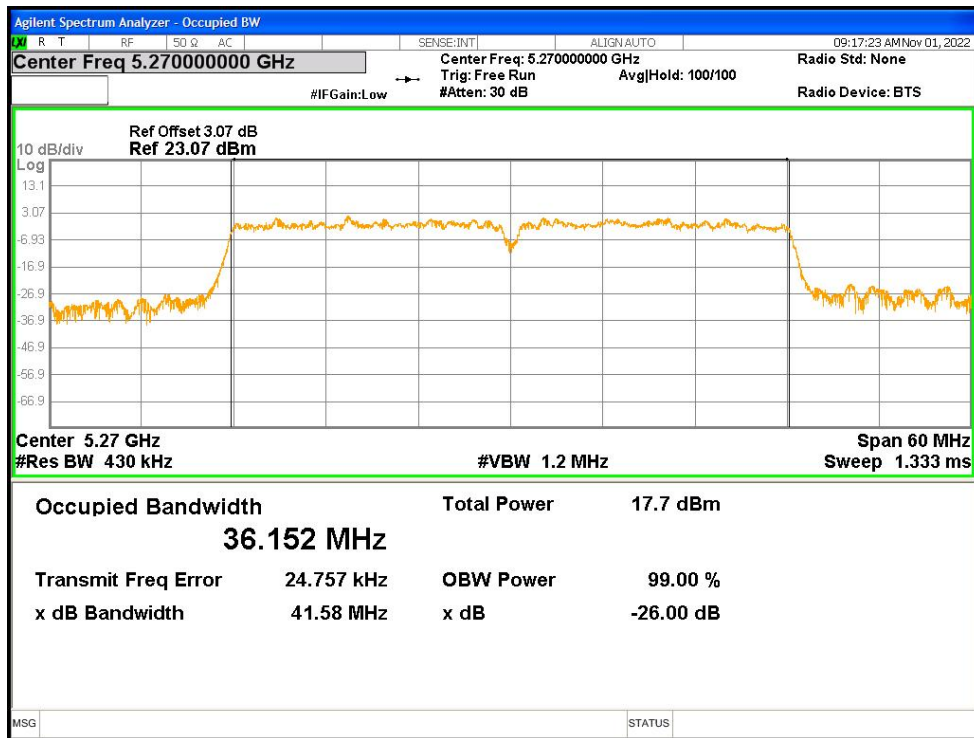


OBW NVNT n40 5310MHz Ant1

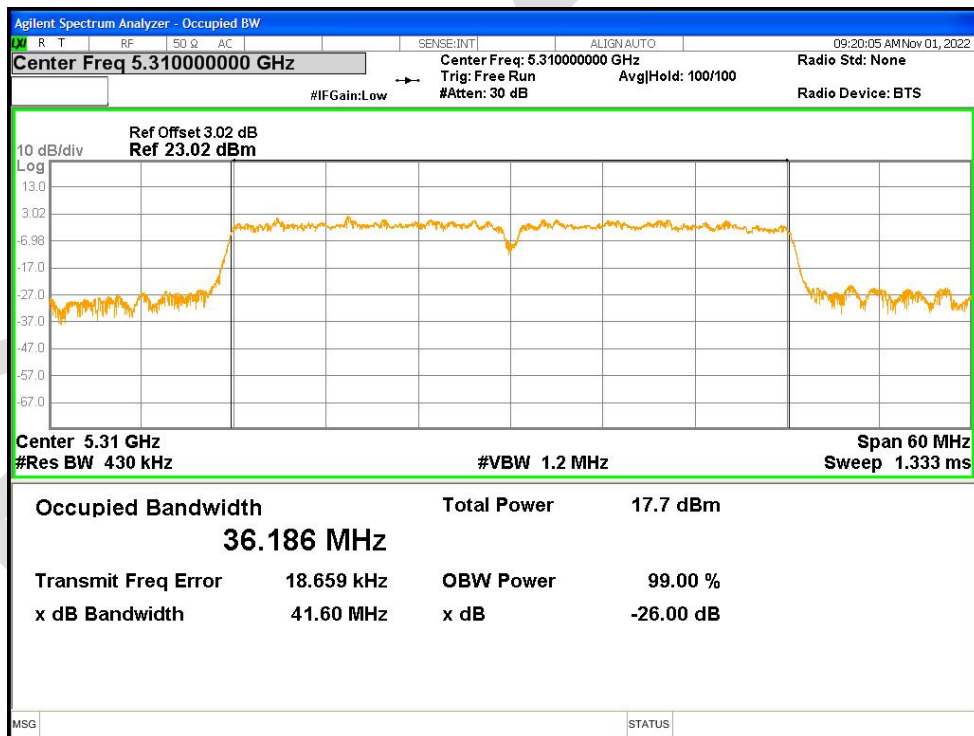


OBW NVNT n40 5510MHz Ant1

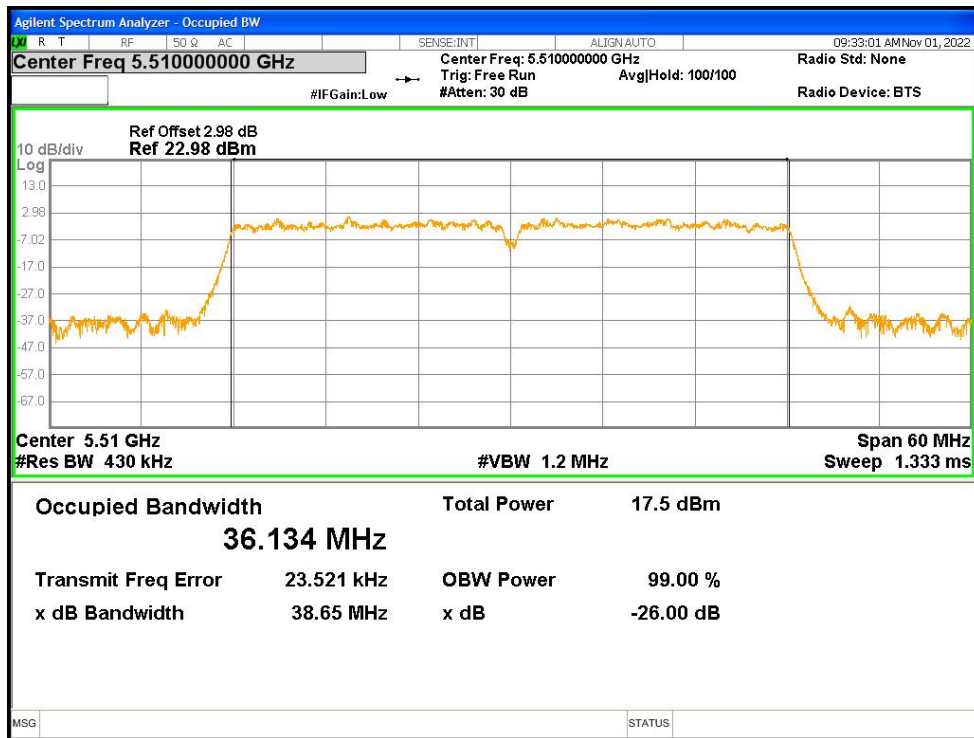


OBW NVNT n40 5590MHz Ant1

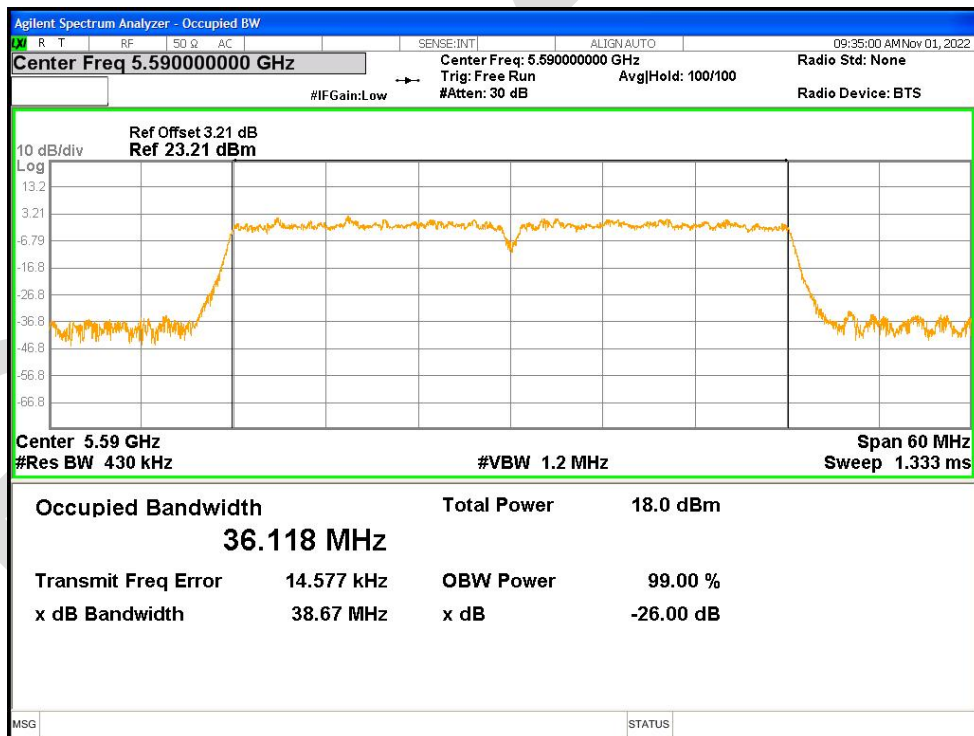


OBW NVNT n40 5670MHz Ant1

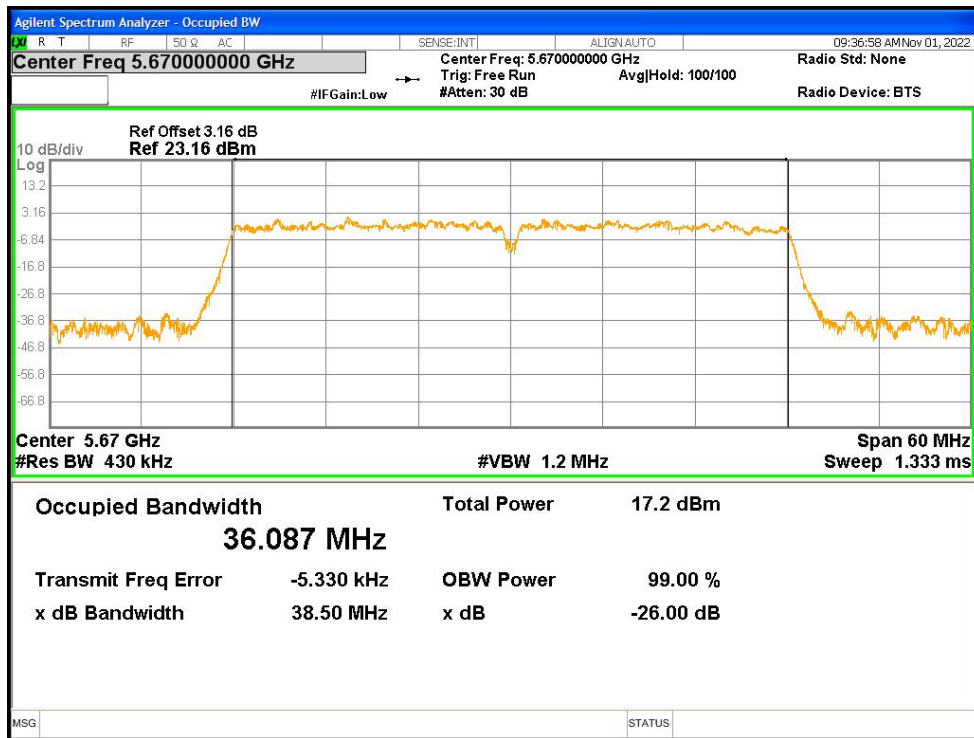


OBW NVNT n40 5755MHz Ant1

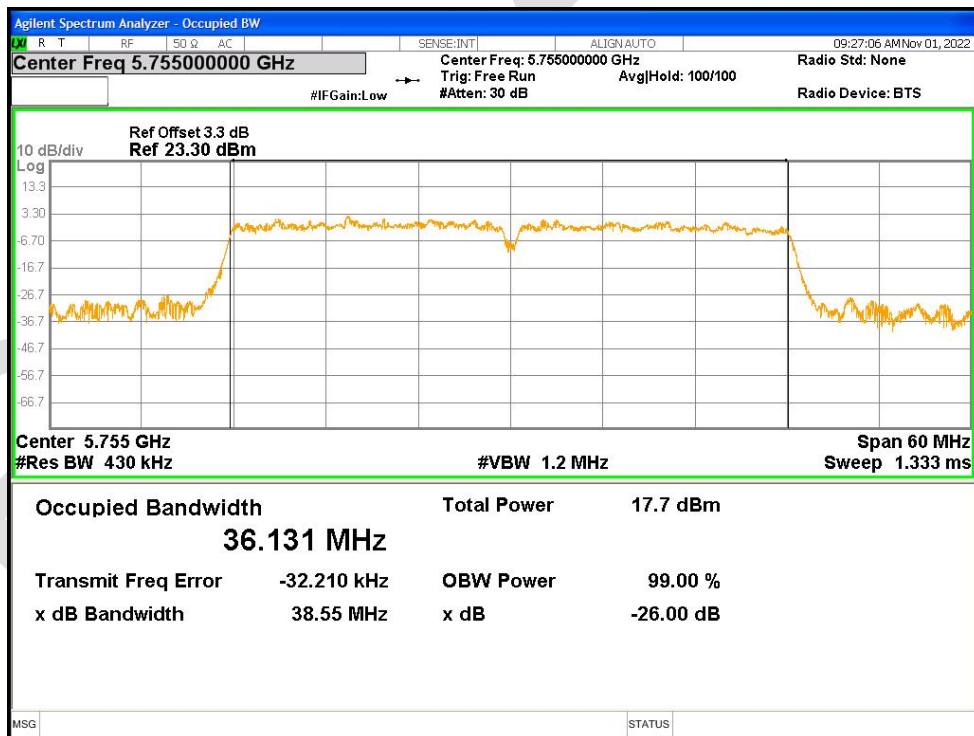


OBW NVNT n40 5795MHz Ant1

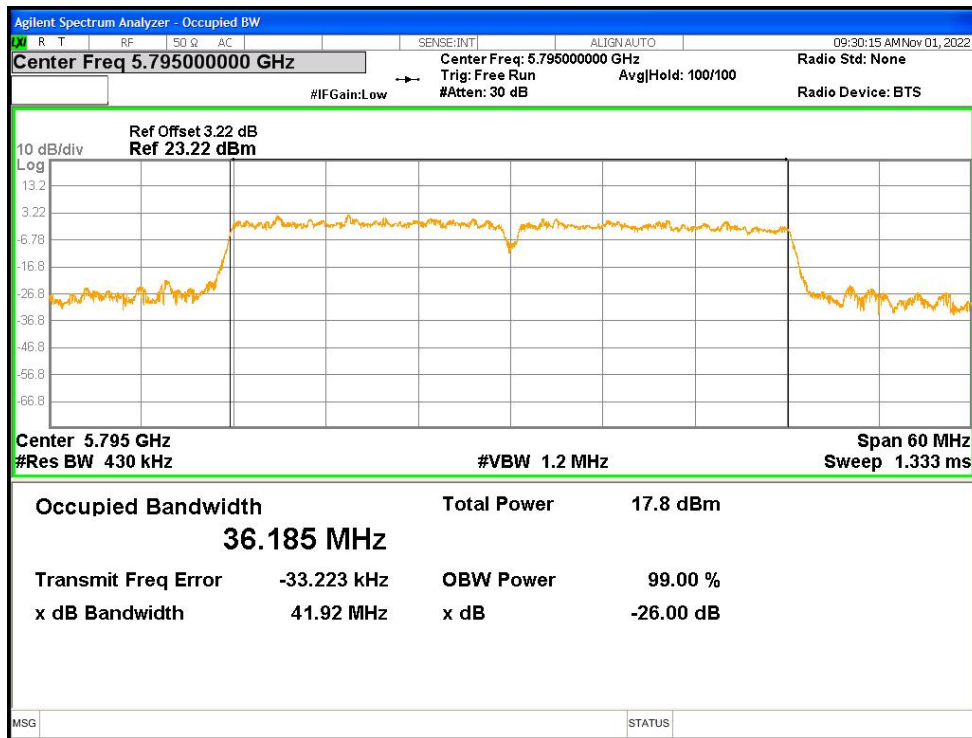


OBW NVNT n40 5190MHz Ant2

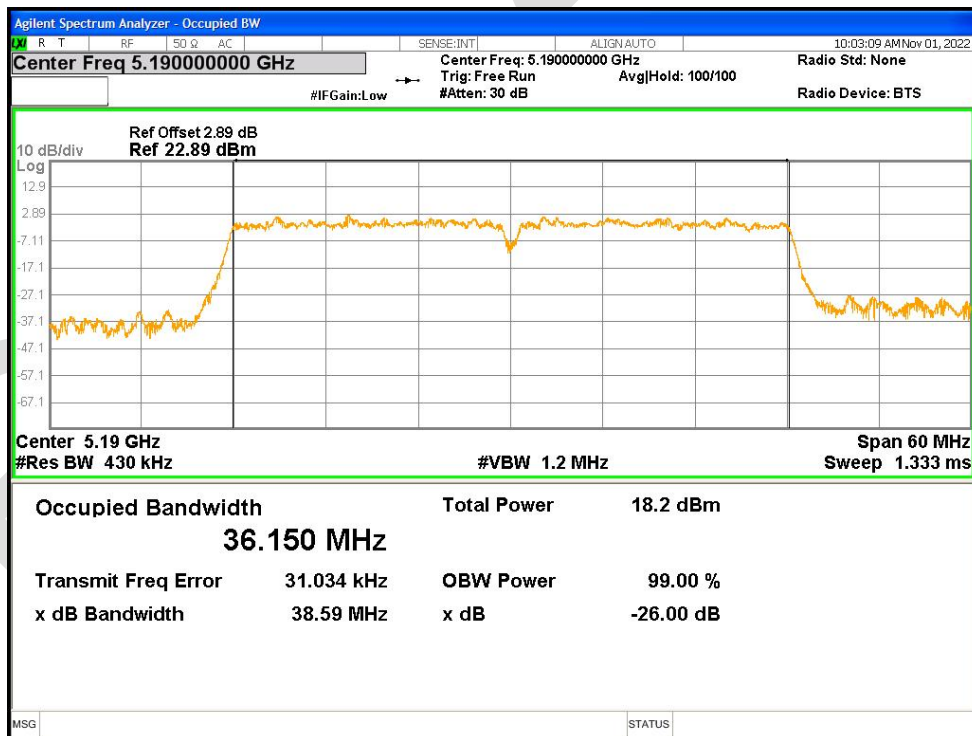


OBW NVNT n40 5230MHz Ant2

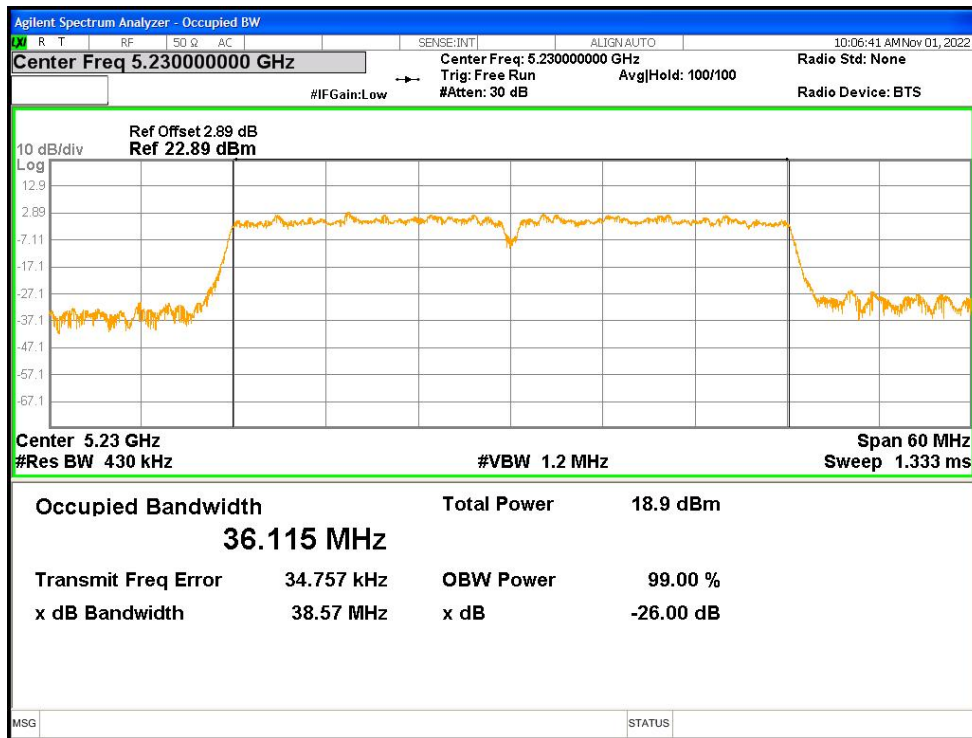


OBW NVNT n40 5270MHz Ant2

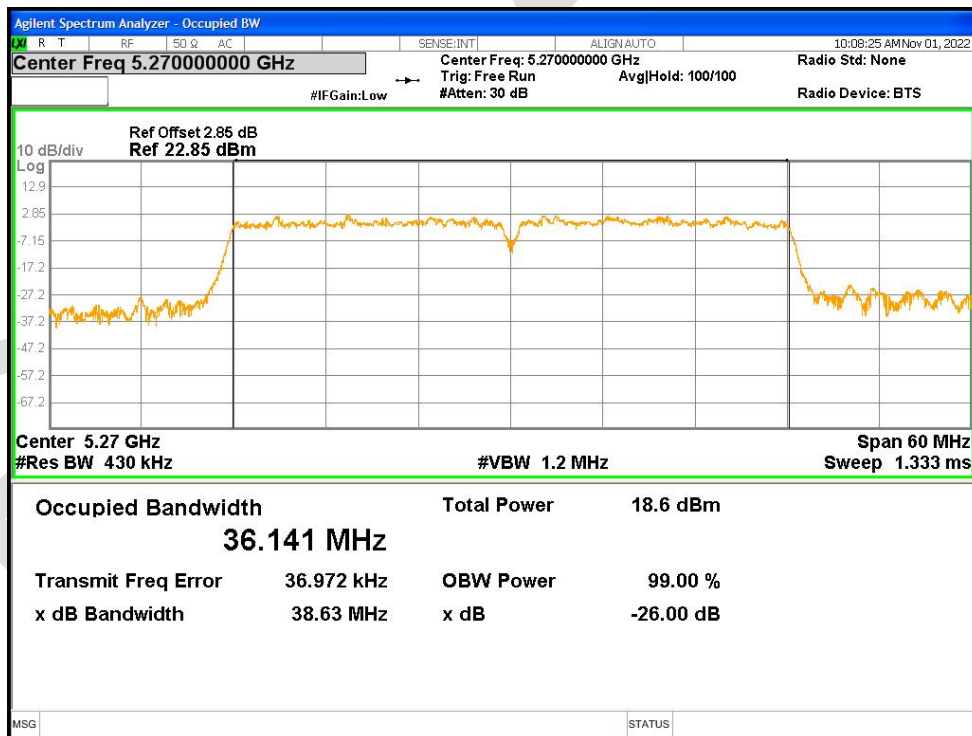


OBW NVNT n40 5310MHz Ant2

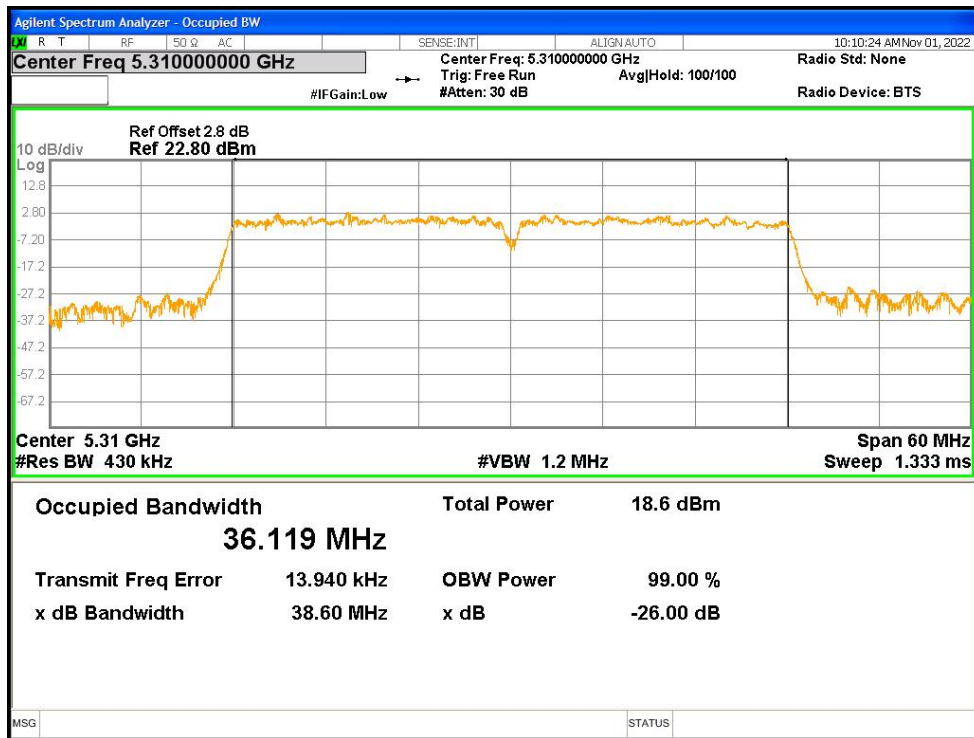


OBW NVNT n40 5510MHz Ant2

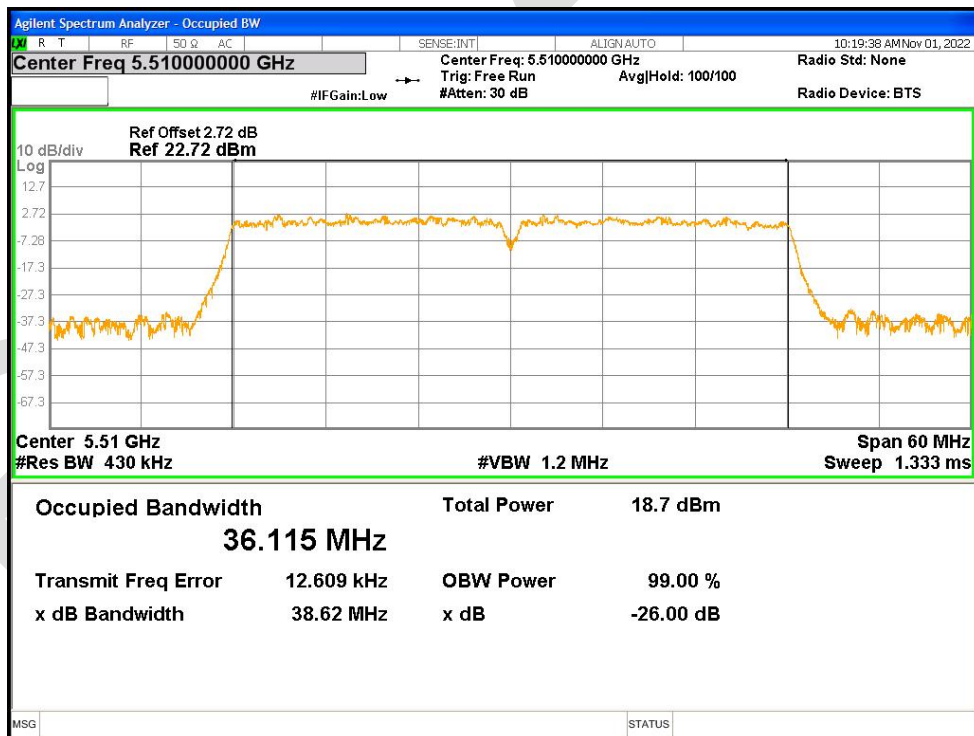


OBW NVNT n40 5590MHz Ant2

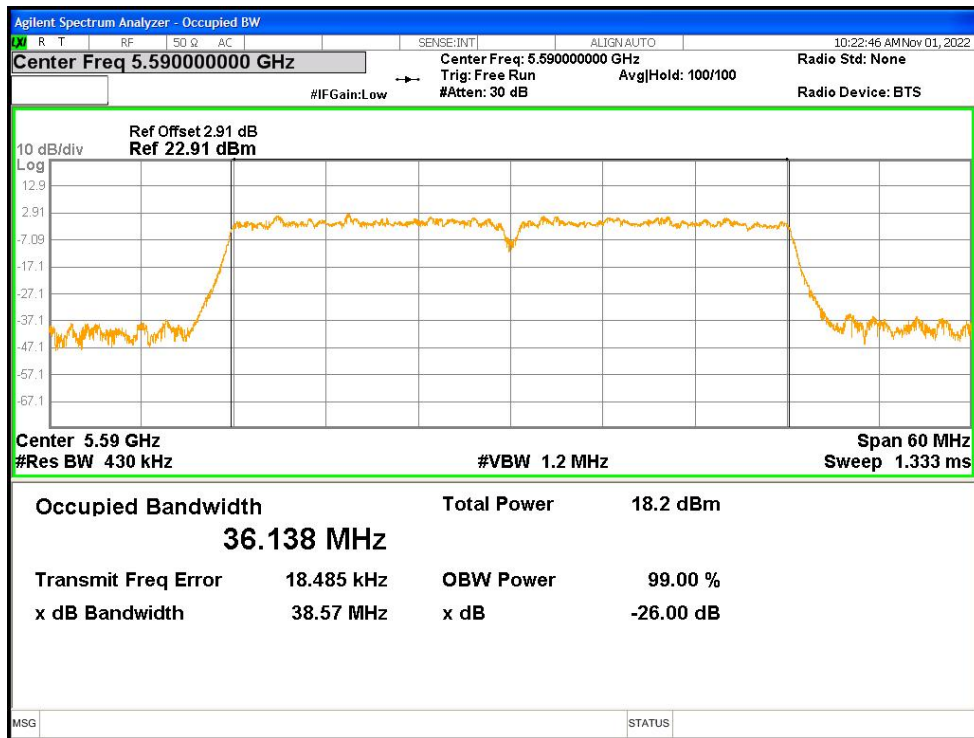


OBW NVNT n40 5670MHz Ant2

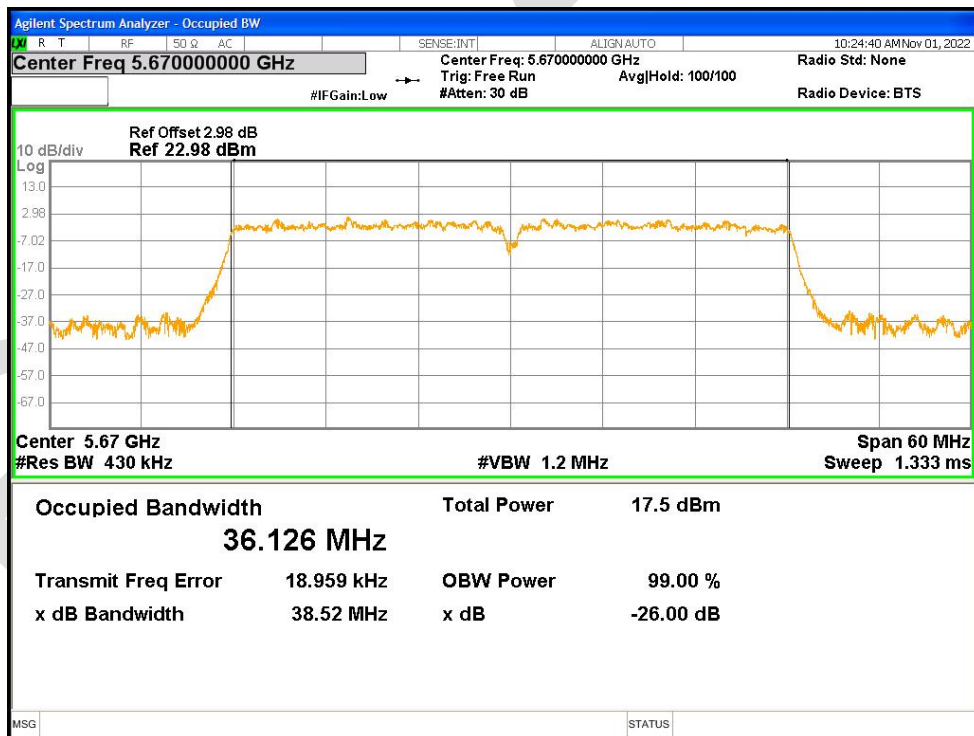

OBW NVNT n40 5755MHz Ant2

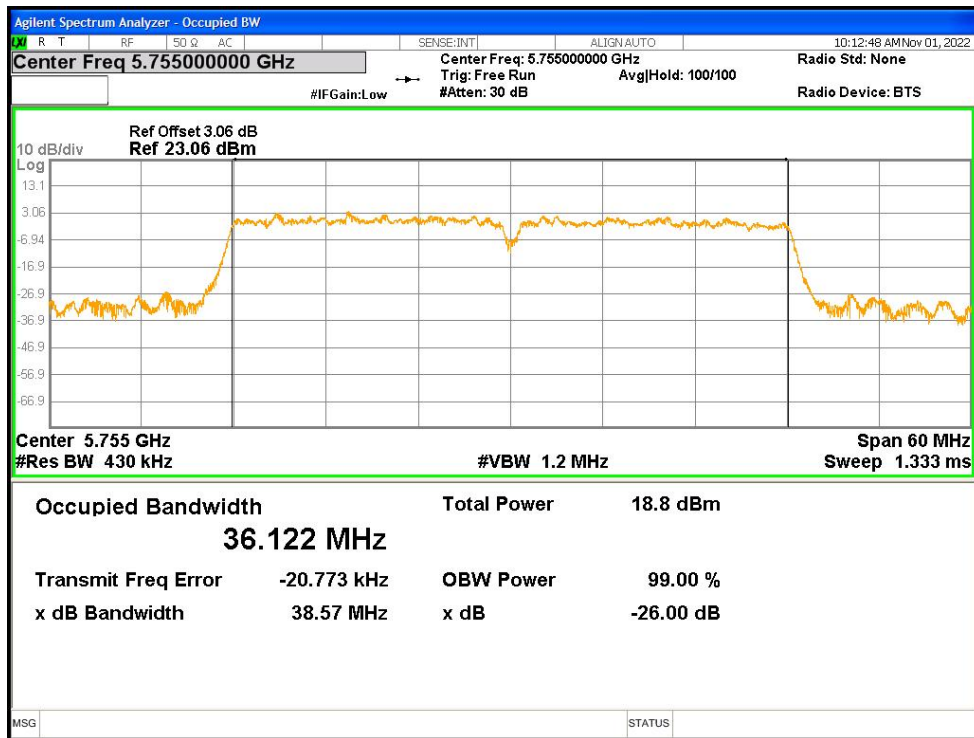

OBW NVNT n40 5795MHz Ant2

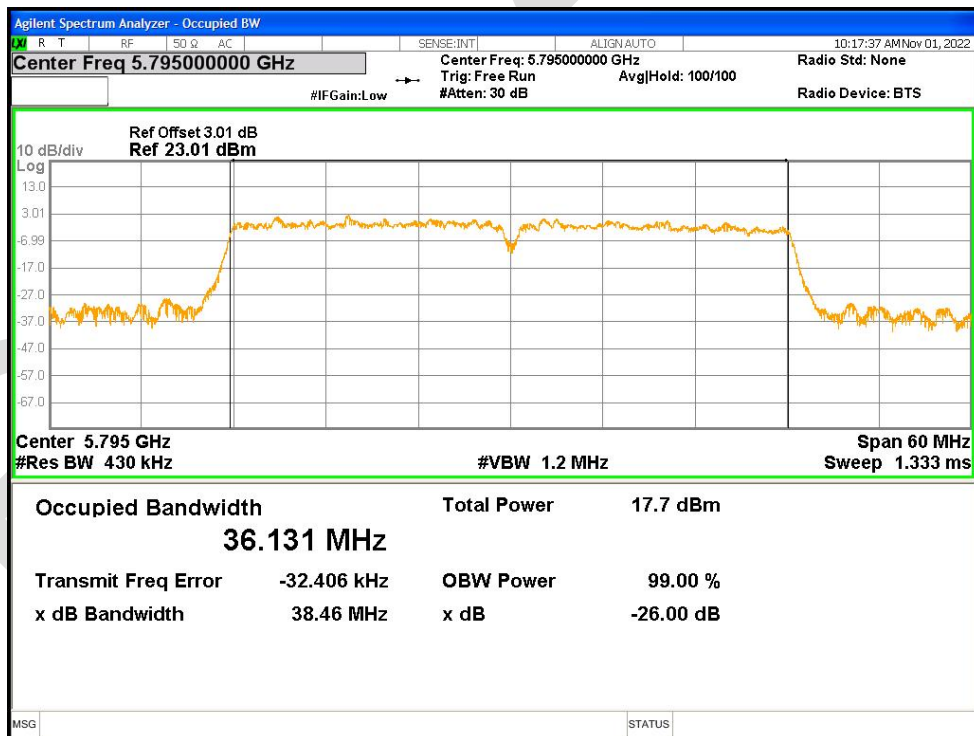

23.5 MAXIMUM POWER SPECTRAL DENSITY LEVEL

Condition	Mode	Frequency (MHz)	Antenna	Max PSD (dBm)	Limit (dBm)	Verdict
SISO						
NVNT	a	5180	Ant1	9.991	11	Pass
NVNT	a	5200	Ant1	10.66	11	Pass
NVNT	a	5240	Ant1	10.295	11	Pass
NVNT	a	5260	Ant1	10.535	11	Pass
NVNT	a	5280	Ant1	10.461	11	Pass
NVNT	a	5320	Ant1	10.198	11	Pass
NVNT	a	5500	Ant1	10.369	11	Pass
NVNT	a	5600	Ant1	10.438	11	Pass
NVNT	a	5700	Ant1	9.42	11	Pass
NVNT	a	5745	Ant1	7.539	30	Pass
NVNT	a	5785	Ant1	6.919	30	Pass
NVNT	a	5825	Ant1	6.107	30	Pass
NVNT	a	5180	Ant2	10.799	11	Pass
NVNT	a	5200	Ant2	10.713	11	Pass
NVNT	a	5240	Ant2	10.292	11	Pass
NVNT	a	5260	Ant2	10.26	11	Pass
NVNT	a	5280	Ant2	10.302	11	Pass
NVNT	a	5320	Ant2	9.861	11	Pass
NVNT	a	5500	Ant2	9.885	11	Pass
NVNT	a	5600	Ant2	10.696	11	Pass
NVNT	a	5700	Ant2	10.057	11	Pass
NVNT	a	5745	Ant2	6.928	30	Pass
NVNT	a	5785	Ant2	7.007	30	Pass
NVNT	a	5825	Ant2	6.148	30	Pass
MIMO						
NVNT	ac20	5180	Ant1	7.316	10.69	Pass
NVNT	ac20	5180	Ant2	6.575	10.69	Pass
NVNT	ac20	5180	Sum	9.972	10.69	Pass
NVNT	ac20	5200	Ant1	7.064	10.69	Pass
NVNT	ac20	5200	Ant2	6.455	10.69	Pass
NVNT	ac20	5200	Sum	9.78	10.69	Pass
NVNT	ac20	5240	Ant1	7.166	10.69	Pass
NVNT	ac20	5240	Ant2	7.134	10.69	Pass
NVNT	ac20	5240	Sum	10.16	10.69	Pass
NVNT	ac20	5260	Ant1	7.179	10.69	Pass
NVNT	ac20	5260	Ant2	6.855	10.69	Pass
NVNT	ac20	5260	Sum	10.03	10.69	Pass
NVNT	ac20	5280	Ant1	7.001	10.69	Pass
NVNT	ac20	5280	Ant2	7.11	10.69	Pass
NVNT	ac20	5280	Sum	10.066	10.69	Pass
NVNT	ac20	5320	Ant1	6.475	10.69	Pass
NVNT	ac20	5320	Ant2	7.843	10.69	Pass

NVNT	ac20	5320	Sum	10.223	10.69	Pass
NVNT	ac20	5500	Ant1	6.723	10.69	Pass
NVNT	ac20	5500	Ant2	7.936	10.69	Pass
NVNT	ac20	5500	Sum	10.382	10.69	Pass
NVNT	ac20	5600	Ant1	7.295	10.69	Pass
NVNT	ac20	5600	Ant2	7.536	10.69	Pass
NVNT	ac20	5600	Sum	10.427	10.69	Pass
NVNT	ac20	5700	Ant1	7.13	10.69	Pass
NVNT	ac20	5700	Ant2	7.102	10.69	Pass
NVNT	ac20	5700	Sum	10.126	10.69	Pass
NVNT	ac20	5745	Ant1	5.666	29.69	Pass
NVNT	ac20	5745	Ant2	7.062	29.69	Pass
NVNT	ac20	5745	Sum	9.43	29.69	Pass
NVNT	ac20	5785	Ant1	5.476	29.69	Pass
NVNT	ac20	5785	Ant2	6.656	29.69	Pass
NVNT	ac20	5785	Sum	9.116	29.69	Pass
NVNT	ac20	5825	Ant1	5.287	29.69	Pass
NVNT	ac20	5825	Ant2	5.867	29.69	Pass
NVNT	ac20	5825	Sum	8.597	29.69	Pass
NVNT	ac40	5190	Ant1	3.694	10.69	Pass
NVNT	ac40	5190	Ant2	3.768	10.69	Pass
NVNT	ac40	5190	Sum	6.741	10.69	Pass
NVNT	ac40	5230	Ant1	3.697	10.69	Pass
NVNT	ac40	5230	Ant2	4.565	10.69	Pass
NVNT	ac40	5230	Sum	7.163	10.69	Pass
NVNT	ac40	5270	Ant1	3.29	10.69	Pass
NVNT	ac40	5270	Ant2	4.505	10.69	Pass
NVNT	ac40	5270	Sum	6.95	10.69	Pass
NVNT	ac40	5310	Ant1	3.209	10.69	Pass
NVNT	ac40	5310	Ant2	4.339	10.69	Pass
NVNT	ac40	5310	Sum	6.821	10.69	Pass
NVNT	ac40	5510	Ant1	4.294	10.69	Pass
NVNT	ac40	5510	Ant2	5.498	10.69	Pass
NVNT	ac40	5510	Sum	7.948	10.69	Pass
NVNT	ac40	5590	Ant1	4.966	10.69	Pass
NVNT	ac40	5590	Ant2	6.191	10.69	Pass
NVNT	ac40	5590	Sum	8.632	10.69	Pass
NVNT	ac40	5670	Ant1	3.286	10.69	Pass
NVNT	ac40	5670	Ant2	4.356	10.69	Pass
NVNT	ac40	5670	Sum	6.864	10.69	Pass
NVNT	ac40	5755	Ant1	0.517	29.69	Pass
NVNT	ac40	5755	Ant2	3.11	29.69	Pass
NVNT	ac40	5755	Sum	5.015	29.69	Pass
NVNT	ac40	5795	Ant1	0.366	29.69	Pass
NVNT	ac40	5795	Ant2	3.509	29.69	Pass
NVNT	ac40	5795	Sum	5.226	29.69	Pass
NVNT	ac80	5210	Ant1	0.003	10.69	Pass

NVNT	ac80	5210	Ant2	1.196	10.69	Pass
NVNT	ac80	5210	Sum	3.651	10.69	Pass
NVNT	ac80	5290	Ant1	0.225	10.69	Pass
NVNT	ac80	5290	Ant2	2.2	10.69	Pass
NVNT	ac80	5290	Sum	4.334	10.69	Pass
NVNT	ac80	5530	Ant1	0.313	10.69	Pass
NVNT	ac80	5530	Ant2	2.677	10.69	Pass
NVNT	ac80	5530	Sum	4.664	10.69	Pass
NVNT	ac80	5610	Ant1	0.077	10.69	Pass
NVNT	ac80	5610	Ant2	2.406	10.69	Pass
NVNT	ac80	5610	Sum	4.406	10.69	Pass
NVNT	ac80	5690	Ant1	0.556	10.69	Pass
NVNT	ac80	5690	Ant2	2.703	10.69	Pass
NVNT	ac80	5690	Sum	4.771	10.69	Pass
NVNT	ac80	5775	Ant1	-3.178	29.69	Pass
NVNT	ac80	5775	Ant2	0.592	29.69	Pass
NVNT	ac80	5775	Sum	2.114	29.69	Pass
NVNT	n20	5180	Ant1	6.976	10.69	Pass
NVNT	n20	5180	Ant2	7.832	10.69	Pass
NVNT	n20	5180	Sum	10.435	10.69	Pass
NVNT	n20	5200	Ant1	7.05	10.69	Pass
NVNT	n20	5200	Ant2	7.51	10.69	Pass
NVNT	n20	5200	Sum	10.296	10.69	Pass
NVNT	n20	5240	Ant1	7.524	10.69	Pass
NVNT	n20	5240	Ant2	7.017	10.69	Pass
NVNT	n20	5240	Sum	10.288	10.69	Pass
NVNT	n20	5260	Ant1	7.506	10.69	Pass
NVNT	n20	5260	Ant2	7.744	10.69	Pass
NVNT	n20	5260	Sum	10.637	10.69	Pass
NVNT	n20	5280	Ant1	7.4	10.69	Pass
NVNT	n20	5280	Ant2	7.791	10.69	Pass
NVNT	n20	5280	Sum	10.61	10.69	Pass
NVNT	n20	5320	Ant1	6.296	10.69	Pass
NVNT	n20	5320	Ant2	7.751	10.69	Pass
NVNT	n20	5320	Sum	10.094	10.69	Pass
NVNT	n20	5500	Ant1	6.662	10.69	Pass
NVNT	n20	5500	Ant2	8.371	10.69	Pass
NVNT	n20	5500	Sum	10.61	10.69	Pass
NVNT	n20	5600	Ant1	6.483	10.69	Pass
NVNT	n20	5600	Ant2	7.784	10.69	Pass
NVNT	n20	5600	Sum	10.192	10.69	Pass
NVNT	n20	5700	Ant1	7.041	10.69	Pass
NVNT	n20	5700	Ant2	7.044	10.69	Pass
NVNT	n20	5700	Sum	10.053	10.69	Pass
NVNT	n20	5745	Ant1	4.555	29.69	Pass
NVNT	n20	5745	Ant2	7.052	29.69	Pass
NVNT	n20	5745	Sum	8.991	29.69	Pass

NVNT	n20	5785	Ant1	4.905	29.69	Pass
NVNT	n20	5785	Ant2	7.363	29.69	Pass
NVNT	n20	5785	Sum	9.316	29.69	Pass
NVNT	n20	5825	Ant1	4.972	29.69	Pass
NVNT	n20	5825	Ant2	6.971	29.69	Pass
NVNT	n20	5825	Sum	9.096	29.69	Pass
NVNT	n40	5190	Ant1	5.183	10.69	Pass
NVNT	n40	5190	Ant2	5.943	10.69	Pass
NVNT	n40	5190	Sum	8.59	10.69	Pass
NVNT	n40	5230	Ant1	5.501	10.69	Pass
NVNT	n40	5230	Ant2	6.682	10.69	Pass
NVNT	n40	5230	Sum	9.142	10.69	Pass
NVNT	n40	5270	Ant1	5.116	10.69	Pass
NVNT	n40	5270	Ant2	6.567	10.69	Pass
NVNT	n40	5270	Sum	8.912	10.69	Pass
NVNT	n40	5310	Ant1	4.823	10.69	Pass
NVNT	n40	5310	Ant2	6.318	10.69	Pass
NVNT	n40	5310	Sum	8.645	10.69	Pass
NVNT	n40	5510	Ant1	4.768	10.69	Pass
NVNT	n40	5510	Ant2	6.674	10.69	Pass
NVNT	n40	5510	Sum	8.835	10.69	Pass
NVNT	n40	5590	Ant1	5.36	10.69	Pass
NVNT	n40	5590	Ant2	7.092	10.69	Pass
NVNT	n40	5590	Sum	9.322	10.69	Pass
NVNT	n40	5670	Ant1	4.527	10.69	Pass
NVNT	n40	5670	Ant2	6.455	10.69	Pass
NVNT	n40	5670	Sum	8.607	10.69	Pass
NVNT	n40	5755	Ant1	1.422	29.69	Pass
NVNT	n40	5755	Ant2	4.183	29.69	Pass
NVNT	n40	5755	Sum	6.029	29.69	Pass
NVNT	n40	5795	Ant1	1.674	29.69	Pass
NVNT	n40	5795	Ant2	4.322	29.69	Pass
NVNT	n40	5795	Sum	6.207	29.69	Pass