

Appendix D: Duty Cycle Test Result


Test Mode	Antenna	Channel	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]
11A	Ant1	5180	2.05	2.19	93.61
		5200	2.06	2.20	93.64
		5240	2.05	2.20	93.18
		5260	2.05	2.22	92.34
		5280	2.05	2.21	92.76
		5320	2.05	2.20	93.18
		5500	2.05	2.15	95.35
		5580	2.05	2.20	93.18
		5700	2.05	2.21	92.76
		5745	2.05	2.22	92.34
		5785	2.05	2.22	92.34
		5825	2.05	2.19	93.61
11N20SISO	Ant1	5180	1.91	2.32	82.33
		5200	1.91	2.08	91.83
		5240	1.90	2.06	92.23
		5260	1.91	2.04	93.63
		5280	1.91	2.08	91.83
		5320	1.91	2.08	91.83
		5500	1.91	2.04	93.63
		5580	1.91	2.07	92.27
		5700	1.91	2.04	93.63
		5745	1.91	2.04	93.63
		5785	1.91	2.05	93.17
		5825	1.90	2.02	94.06
11N40SISO	Ant1	5190	0.94	1.21	77.69
		5230	0.94	1.11	84.68
		5270	0.94	1.10	85.45
		5310	0.93	1.08	86.11
		5510	0.94	1.10	85.45
		5550	0.94	1.12	83.93
		5670	0.94	1.10	85.45
		5755	0.94	1.10	85.45
		5795	0.94	1.08	87.04
11AC20SISO	Ant1	5180	1.92	2.08	92.31
		5200	1.92	2.03	94.58
		5240	1.92	2.10	91.43
		5260	1.92	2.06	93.20
		5280	1.92	2.10	91.43
		5320	1.92	2.04	94.12
		5500	1.92	2.07	92.75
		5580	1.92	2.07	92.75
		5700	1.92	2.09	91.87
		5745	1.92	2.09	91.87
		5785	1.92	2.07	92.75
		5825	1.92	2.04	94.12
11AC40SISO	Ant1	5190	0.94	1.11	84.68
		5230	0.94	1.11	84.68
		5270	0.94	1.12	83.93
		5310	0.95	1.10	86.36
		5510	0.95	1.11	85.59
		5550	0.95	1.12	84.82
		5670	0.95	1.12	84.82
		5755	0.94	1.12	83.93
		5795	0.94	1.12	83.93

11AC80SISO	Ant1	5210	0.45	0.62	72.58
		5290	0.45	0.62	72.58
		5530	0.46	0.57	80.70
		5610	0.45	0.63	71.43
		5775	0.46	0.61	75.41

Test Graphs




11A_Ant1_5260

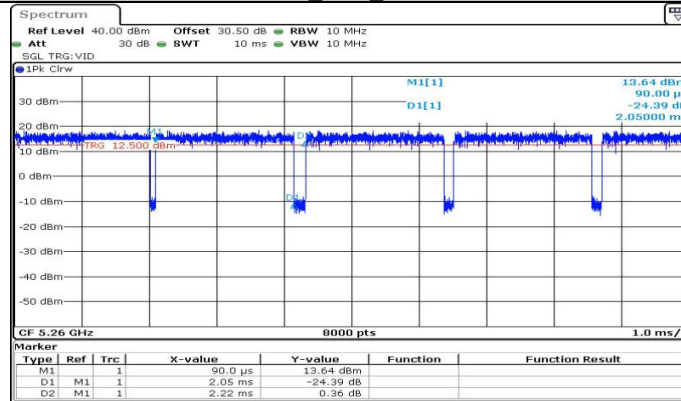


Date: 22.NOV.2021 15:27:08

11A_Ant1_5280

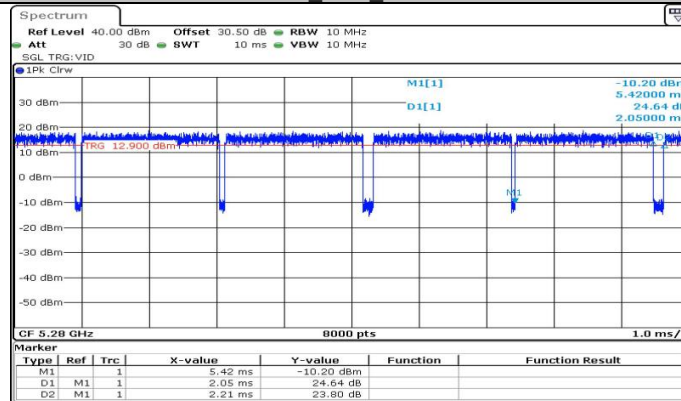


Date: 22.NOV.2021 15:28:38


11A_Ant1_5320

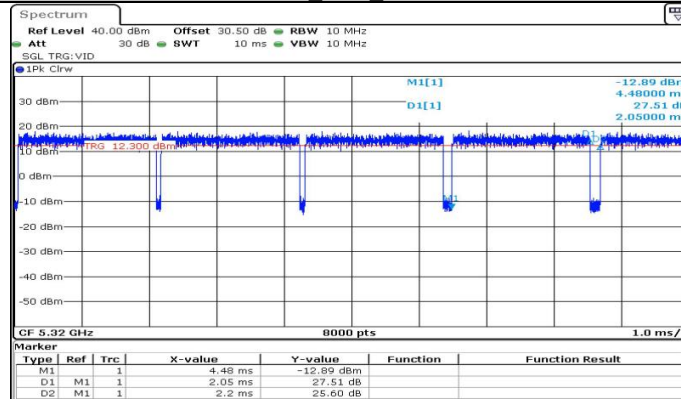


Date: 22.NOV.2021 15:30:04

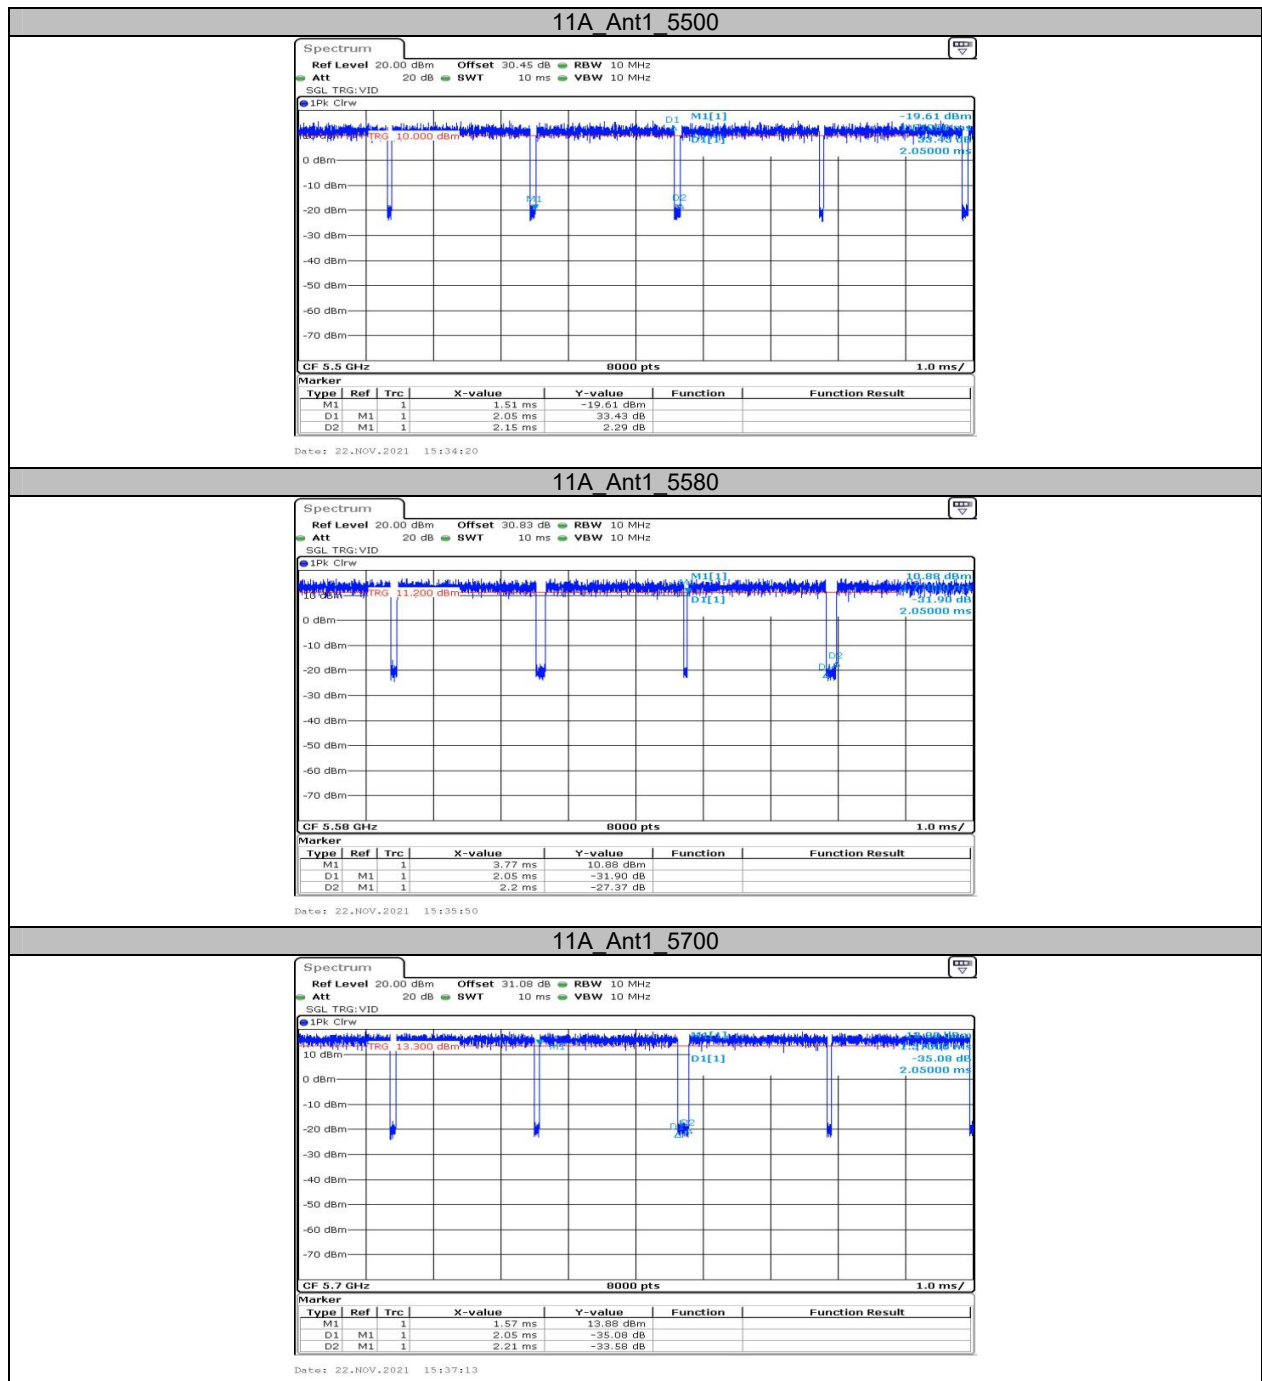


11A_Ant1_5745

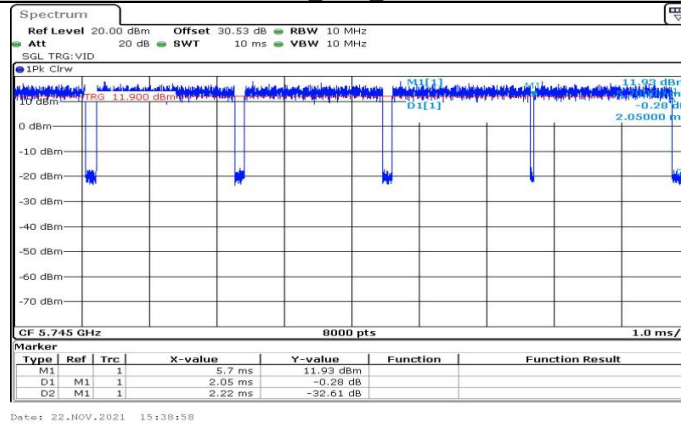


11A_Ant1_5785

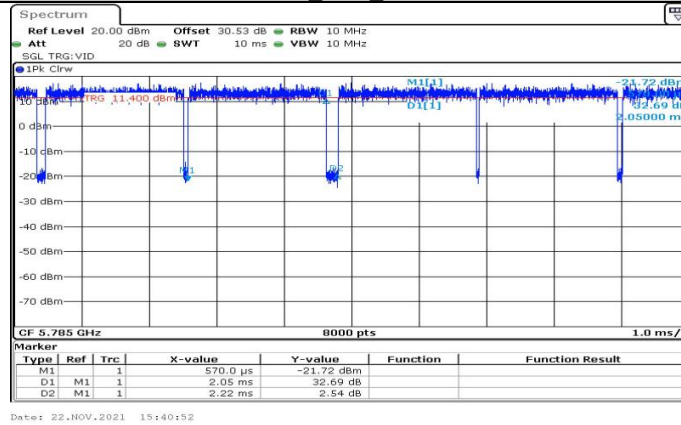


11A_Ant1_5825

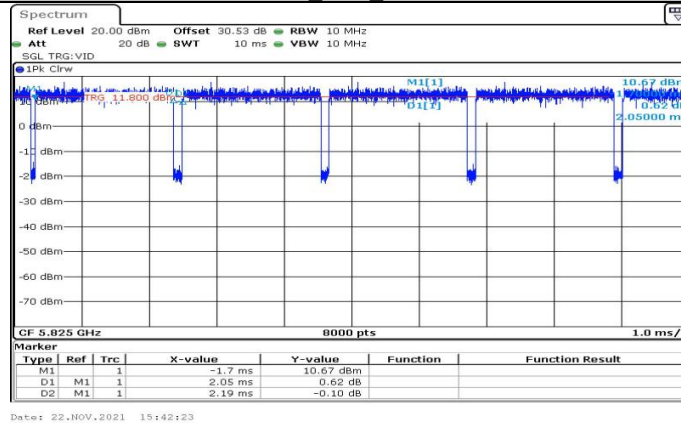


11N20SISO_Ant1_5180

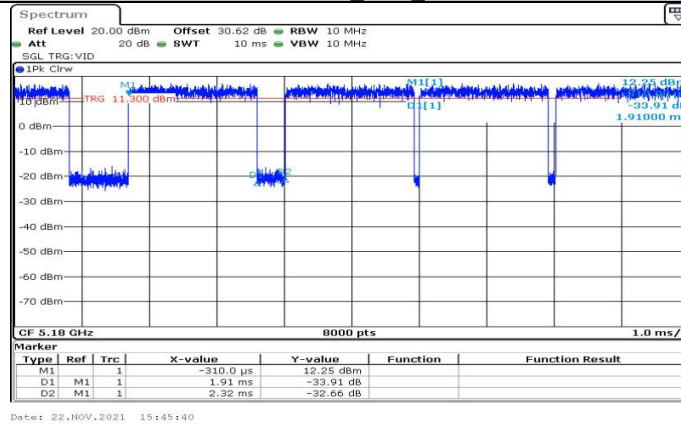

11N20SISO_Ant1_5200

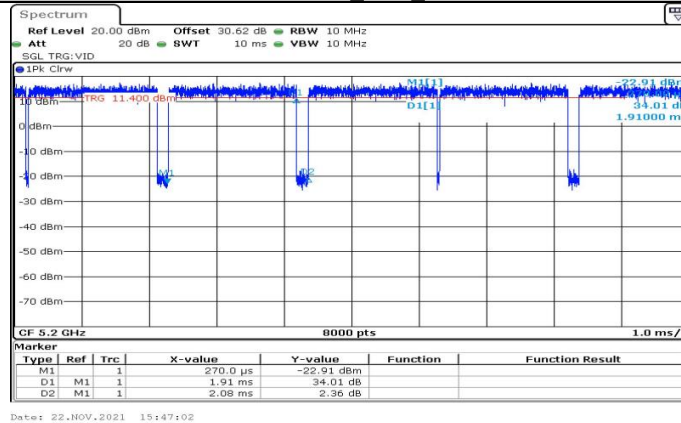


11N20SISO_Ant1_5240

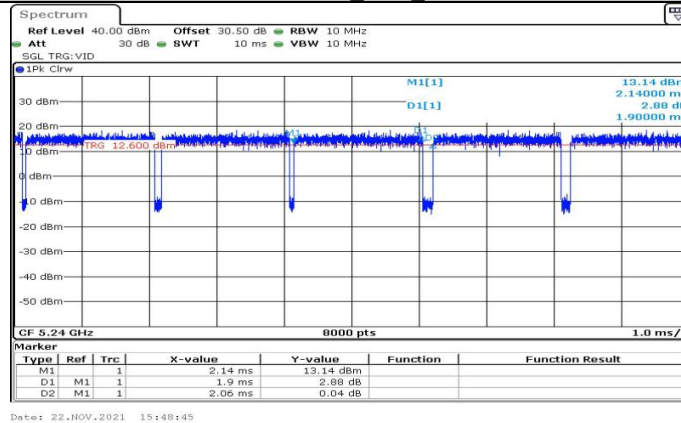






11N20SISO_Ant1_5745

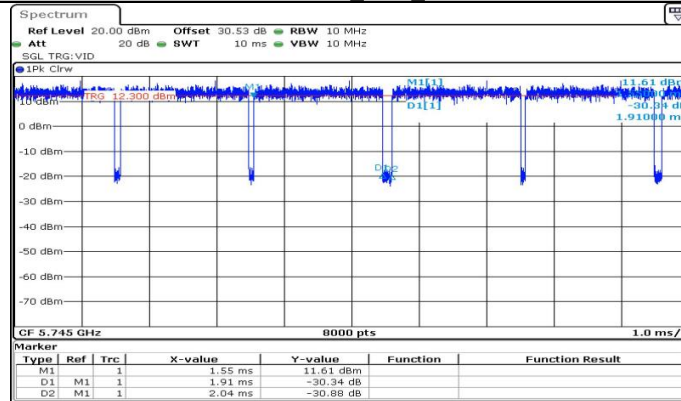


Date: 22.NOV.2021 16:00:28

11N20SISO_Ant1_5785

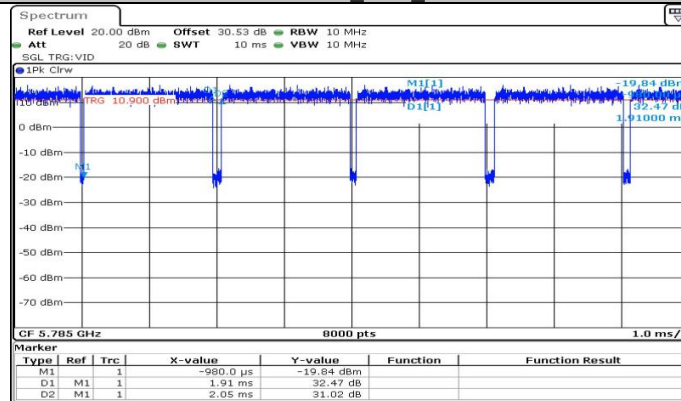


Date: 22.NOV.2021 16:02:38

11N20SISO_Ant1_5825

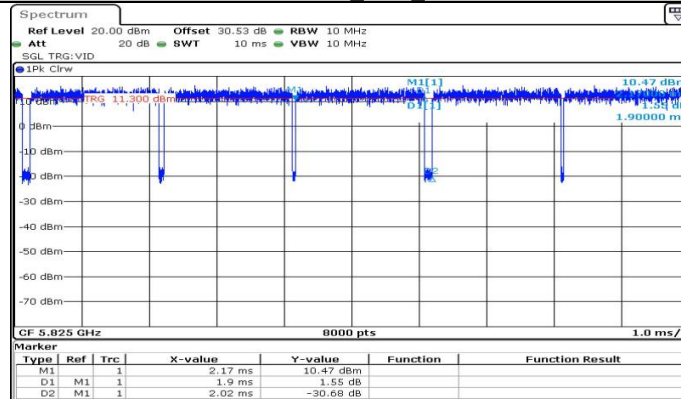


Date: 22.NOV.2021 16:06:27

11N40SISO_Ant1_5190

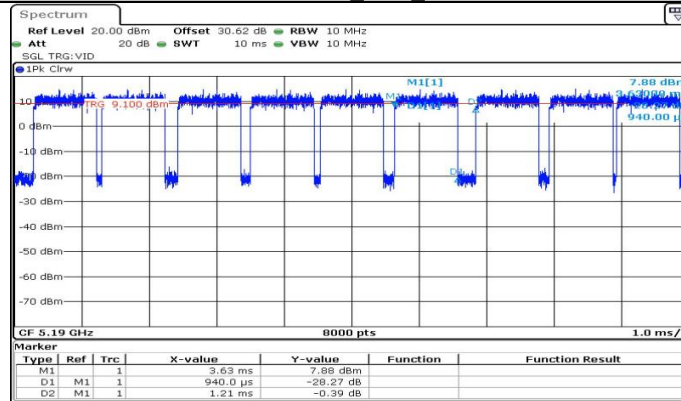


Date: 22.NOV.2021 16:17:34

11N40SISO_Ant1_5230

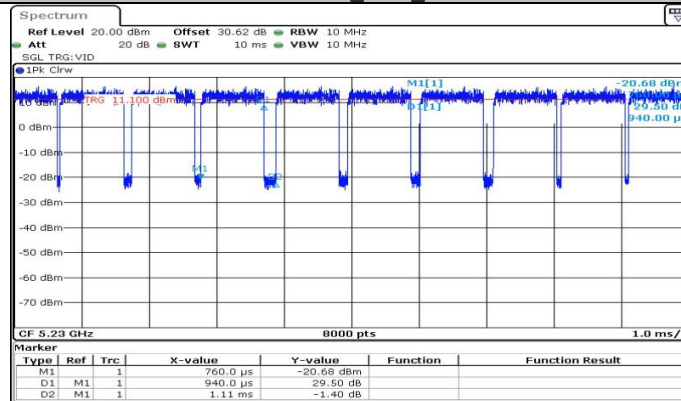


Date: 22.NOV.2021 16:18:42

11N40SISO_Ant1_5270

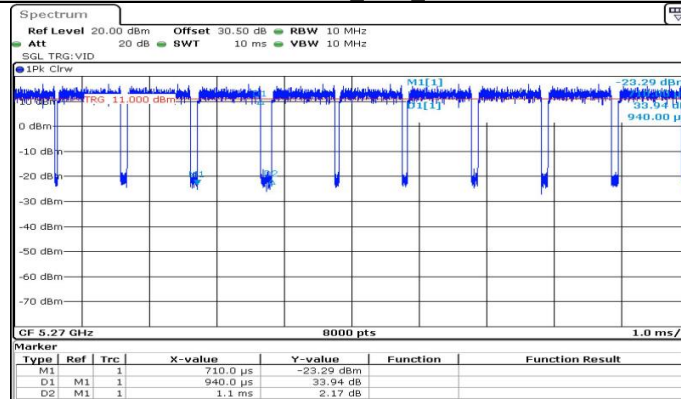


Date: 22.NOV.2021 16:19:52


11N40SISO_Ant1_5310

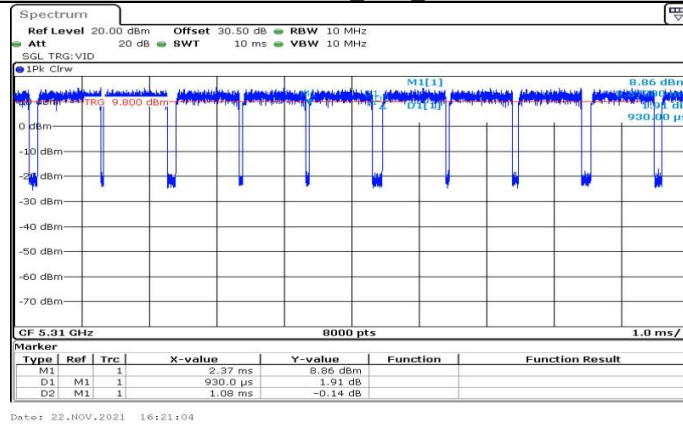


11N40SISO_Ant1_5510

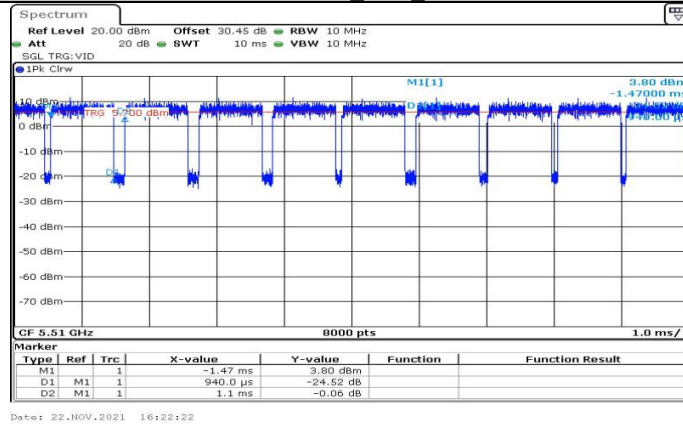


11N40SISO_Ant1_5550

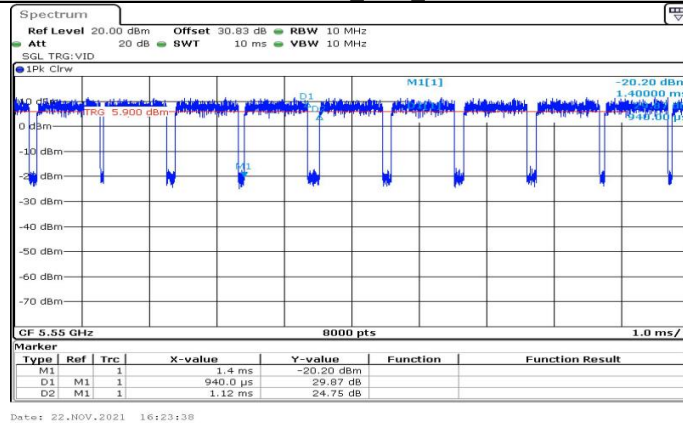


11N40SISO_Ant1_5670

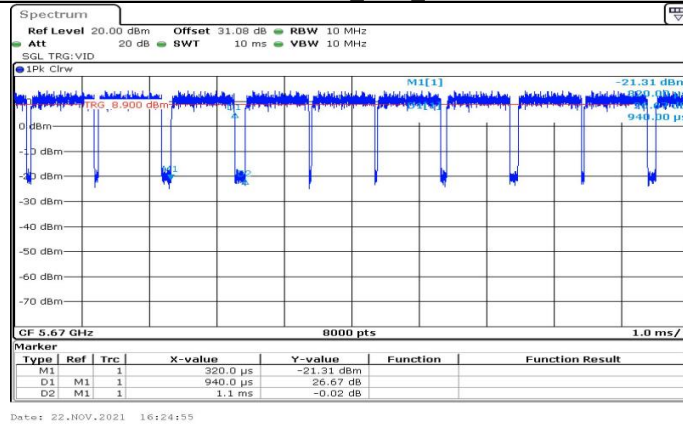


11N40SISO_Ant1_5755

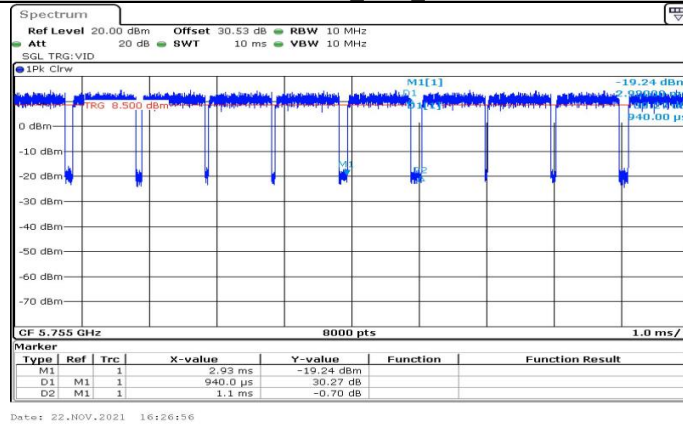


11N40SISO_Ant1_5795

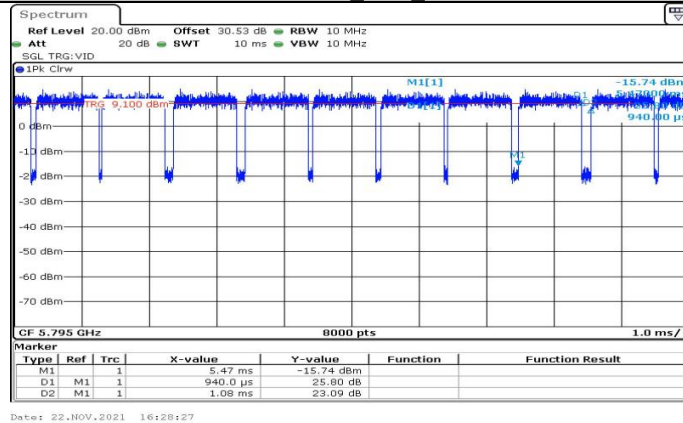


11AC20SISO_Ant1_5180

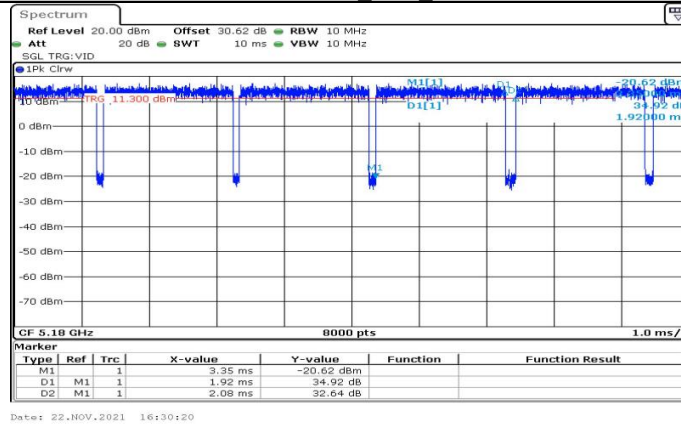


11AC20SISO_Ant1_5200

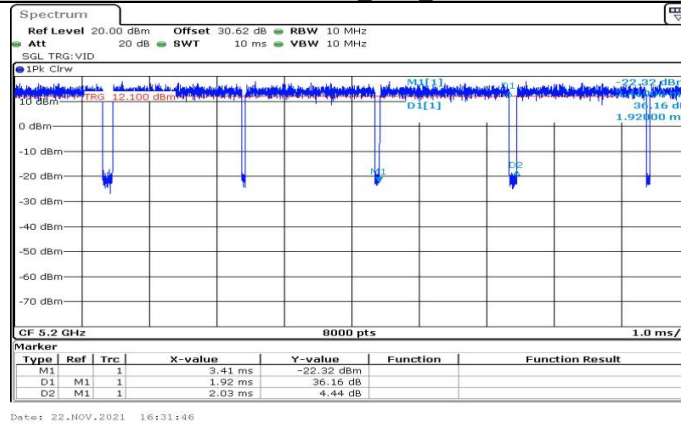


11AC20SISO_Ant1_5240

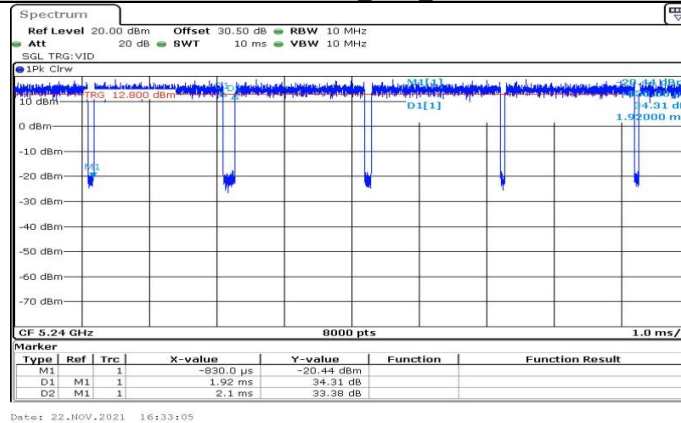


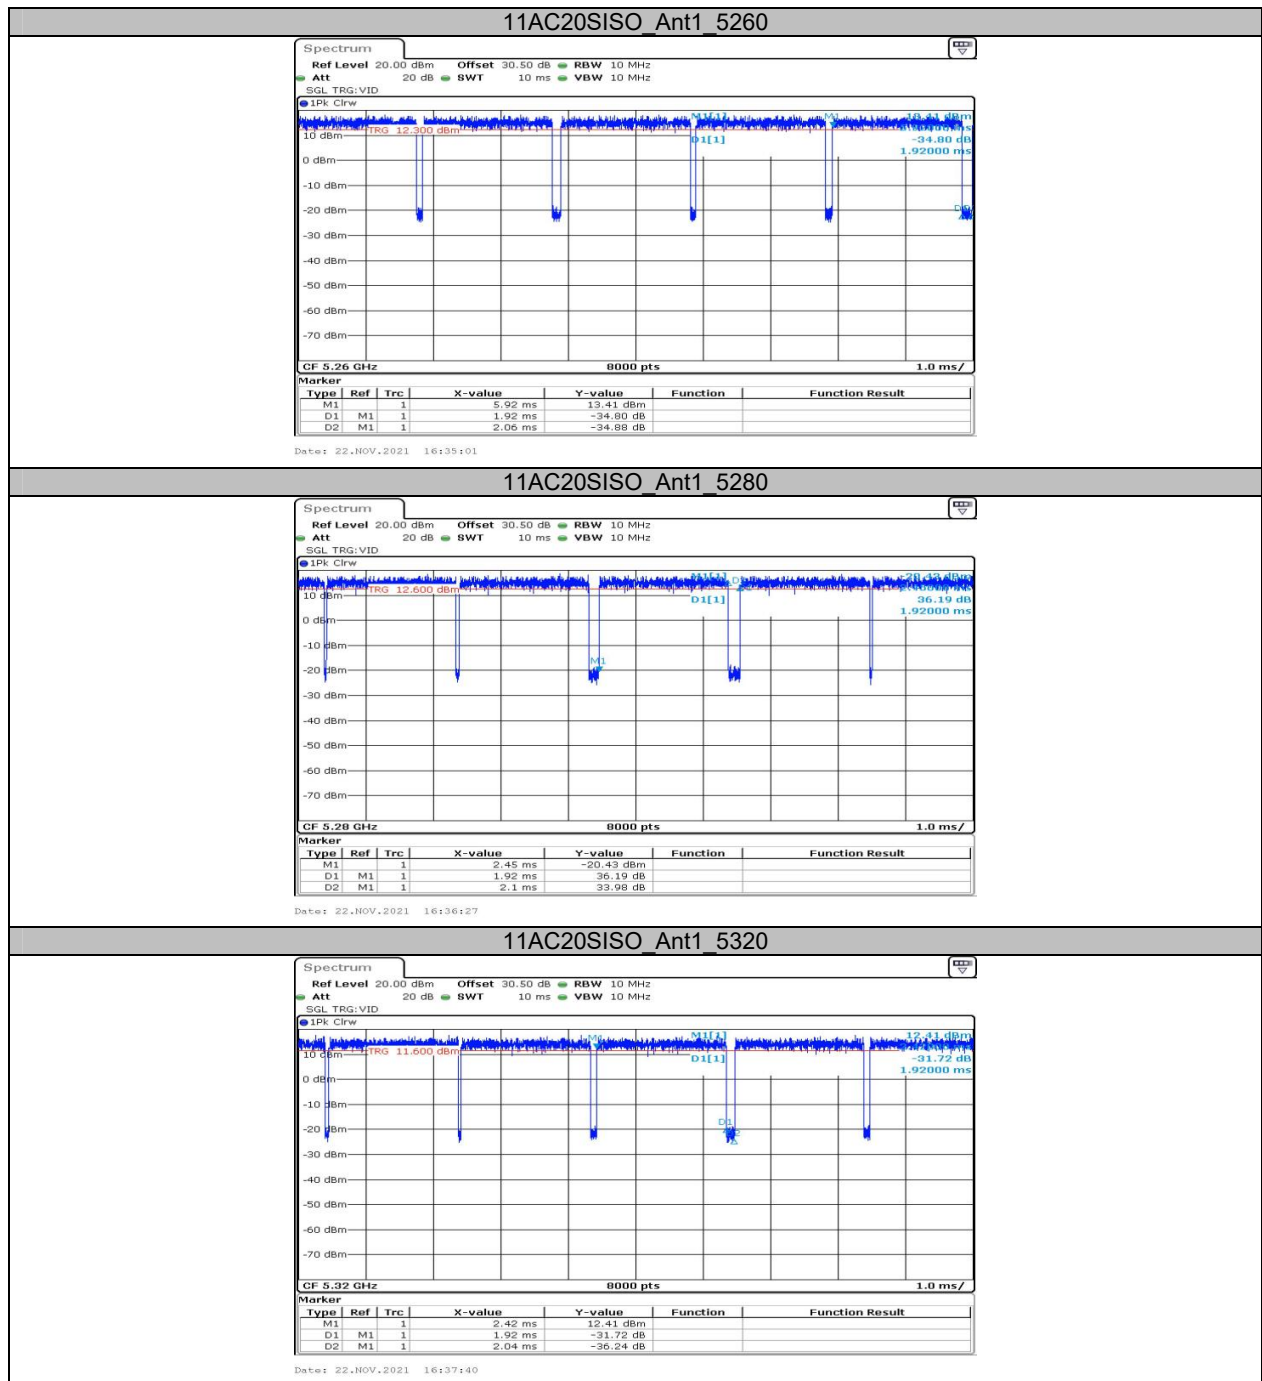


11AC20SISO_Ant1_5500

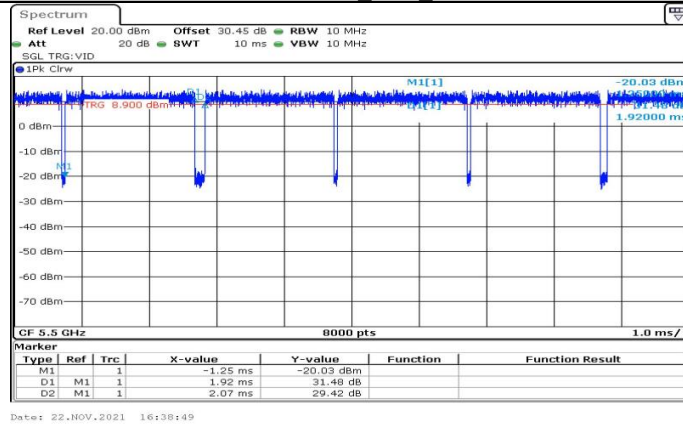


11AC20SISO_Ant1_5580

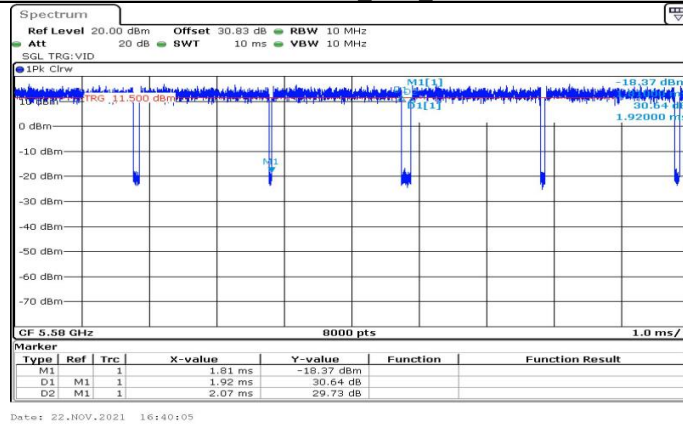

11AC20SISO_Ant1_5700

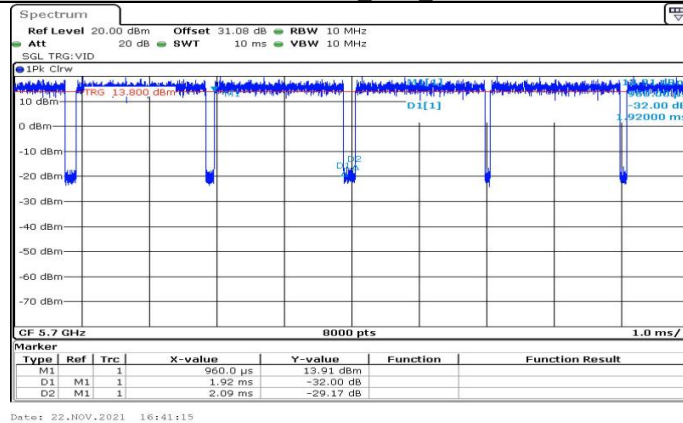


11AC20SISO_Ant1_5745

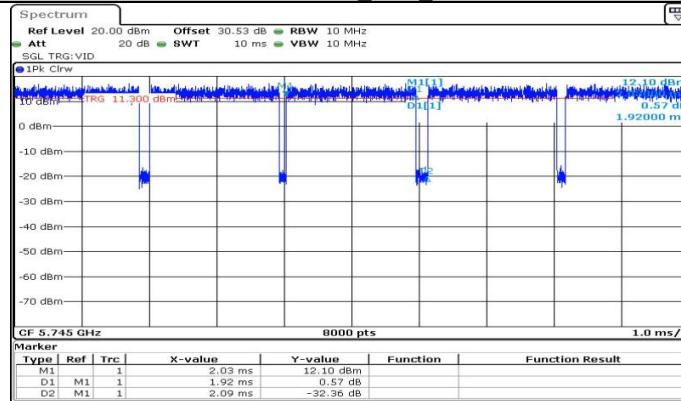


Date: 22.NOV.2021 16:42:42

11AC20SISO_Ant1_5785

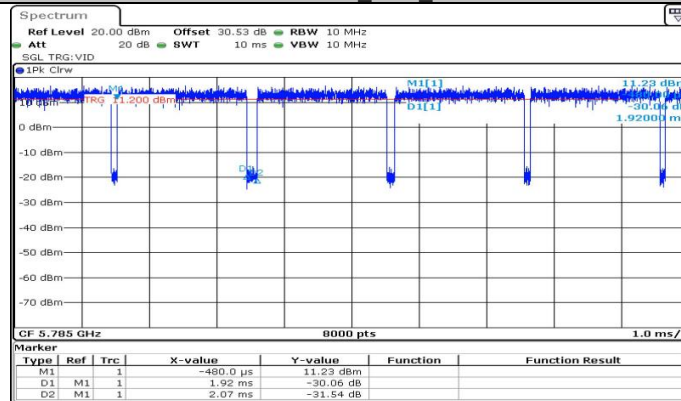


Date: 22.NOV.2021 16:44:06

11AC20SISO_Ant1_5825

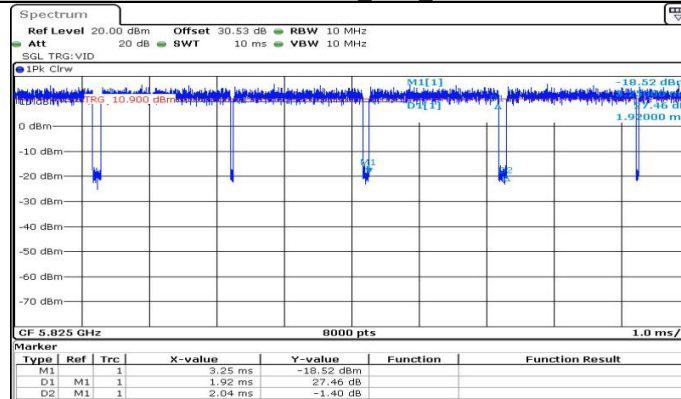


Date: 22.NOV.2021 16:46:03


11AC40SISO_Ant1_5190

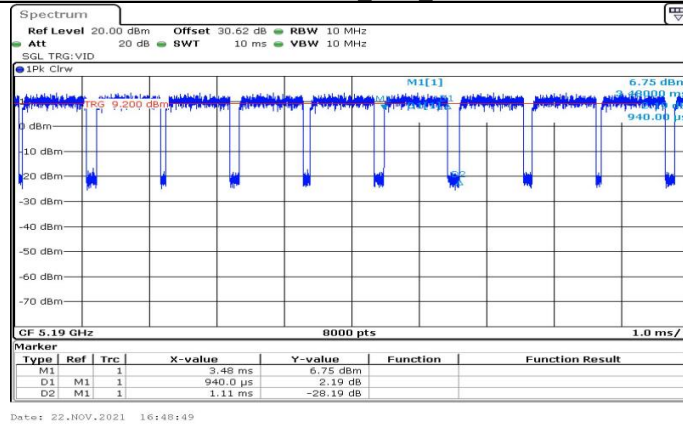


11AC40SISO_Ant1_5230

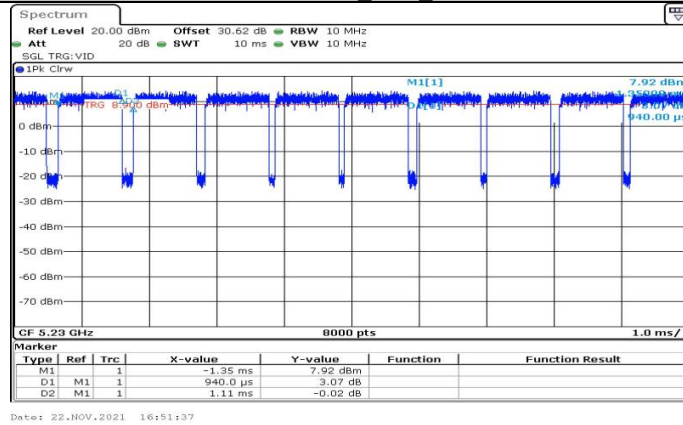


11AC40SISO_Ant1_5270

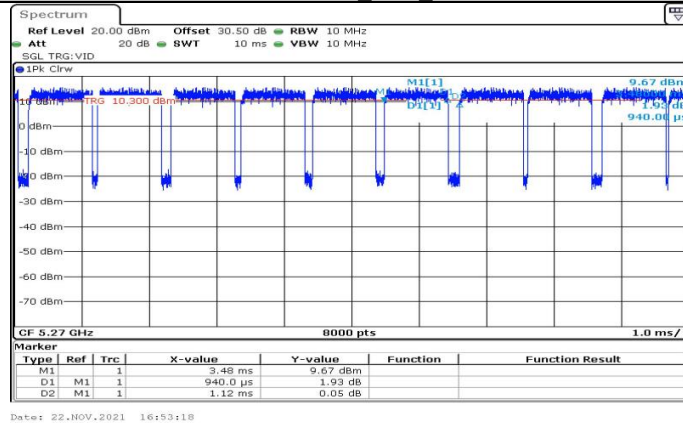


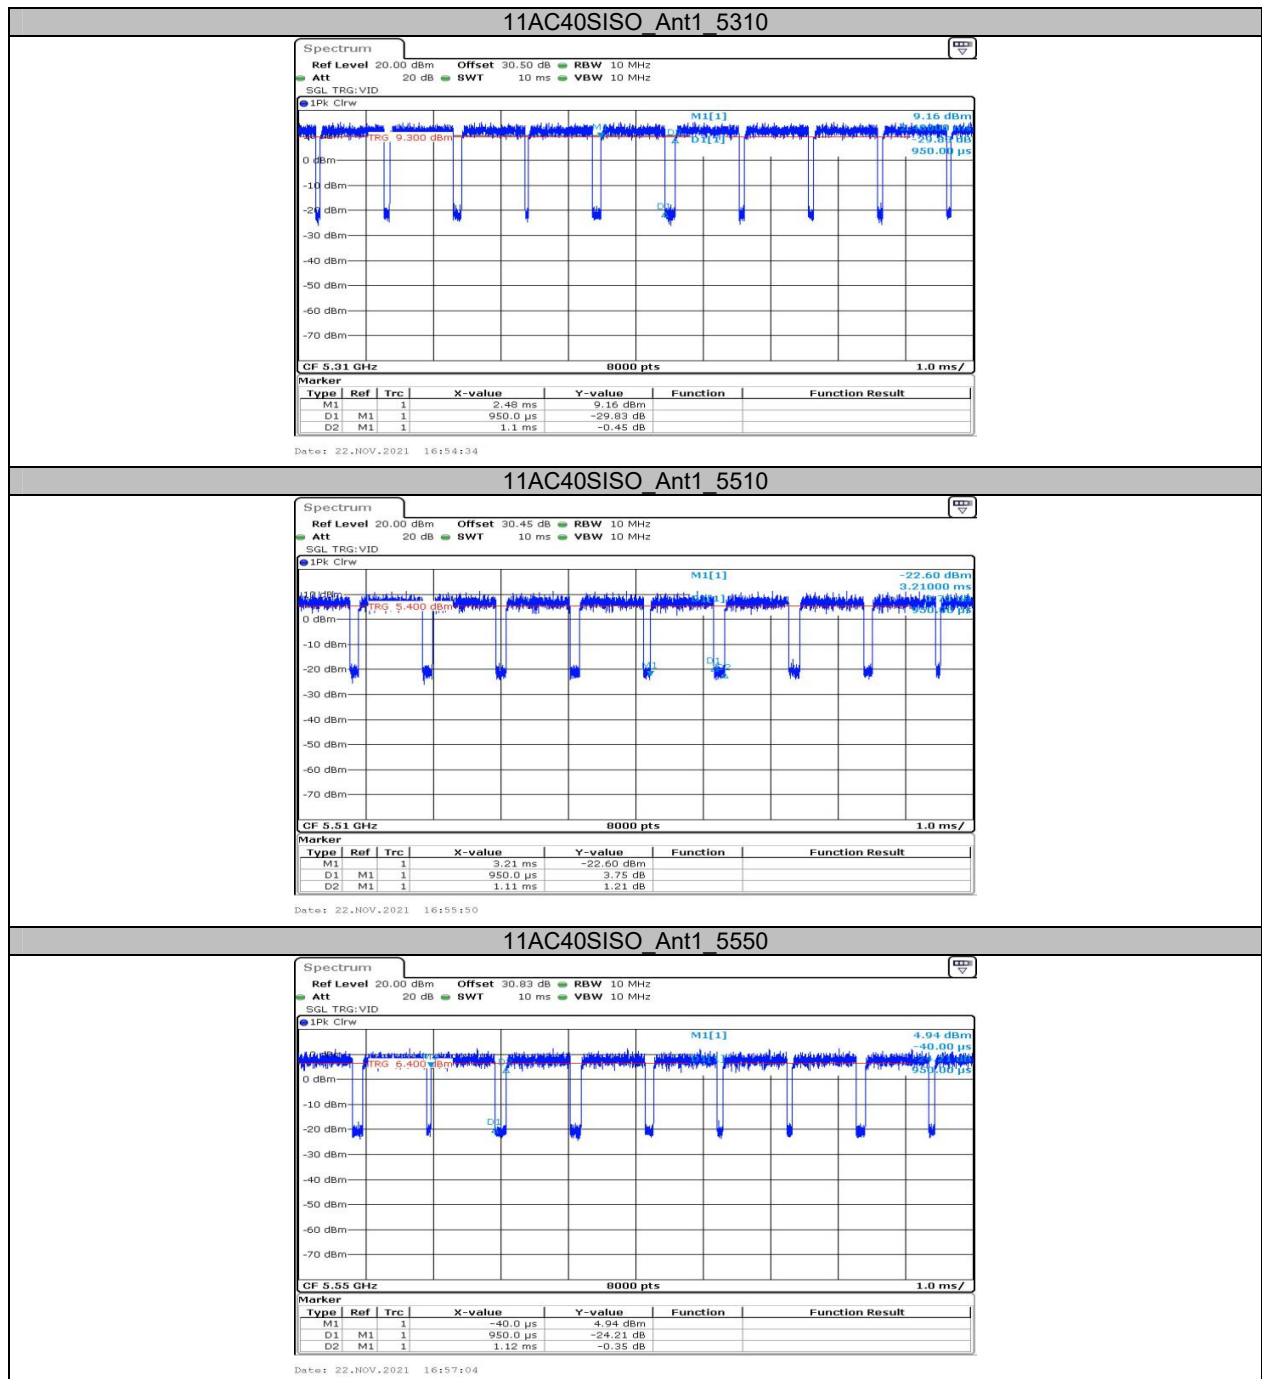


11AC40SISO_Ant1_5670

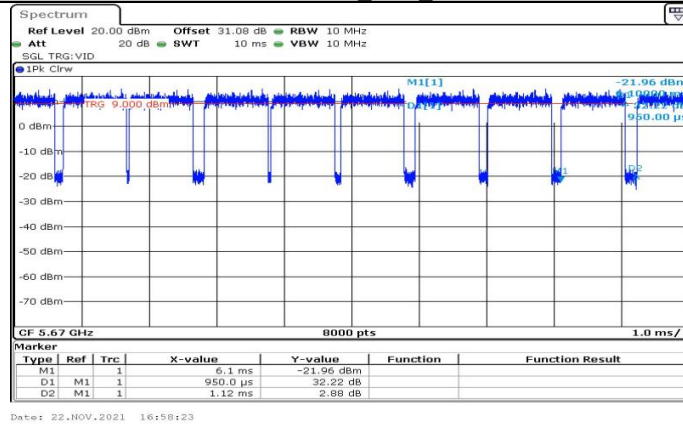


11AC40SISO_Ant1_5755

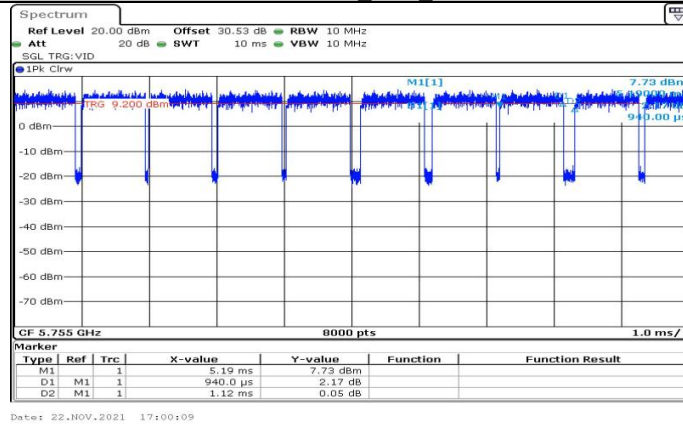


11AC40SISO_Ant1_5795

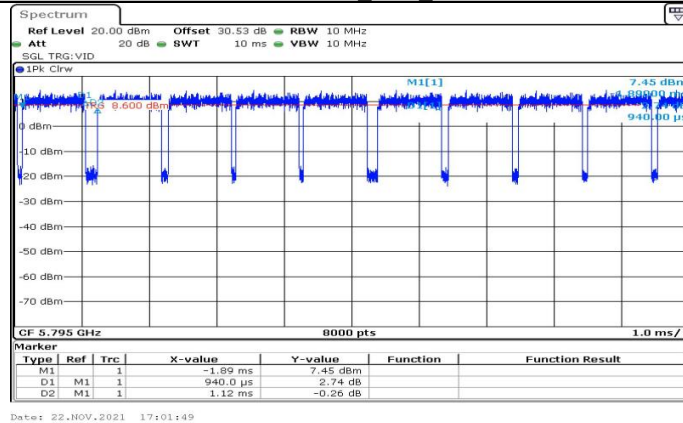


11AC80SISO_Ant1_5210

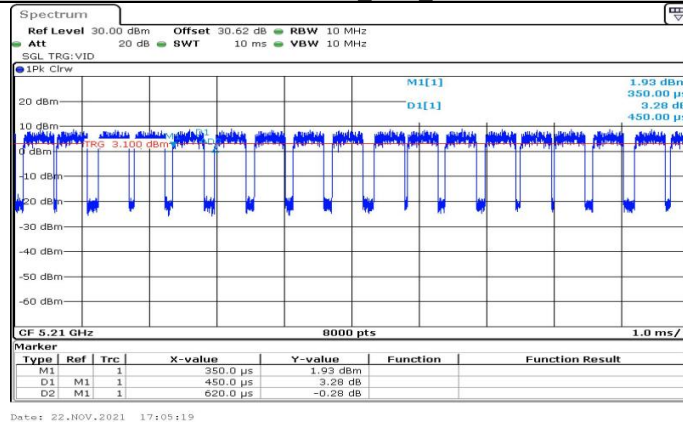


11AC80SISO_Ant1_5290

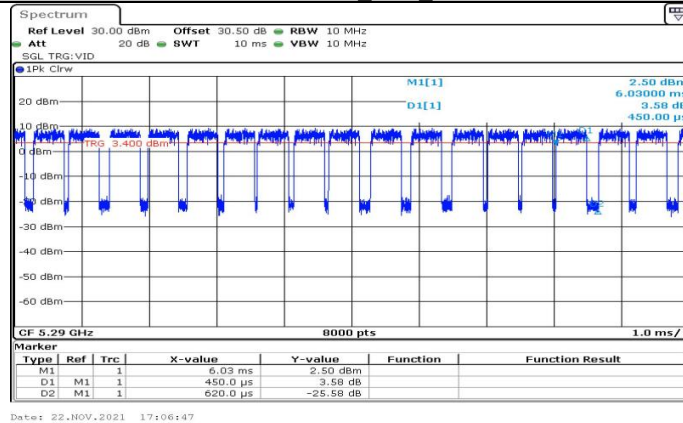

11AC80SISO_Ant1_5530

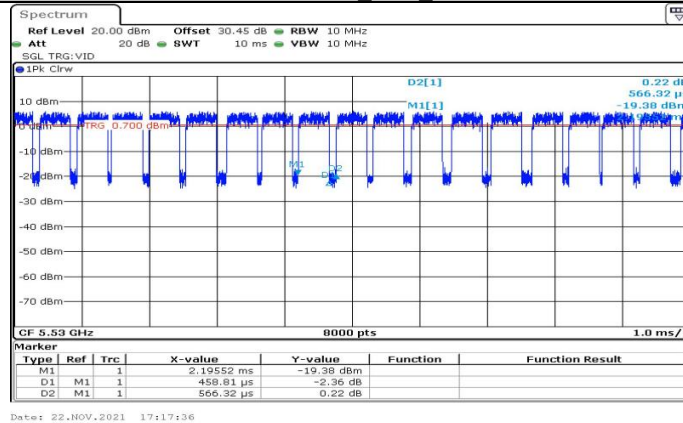

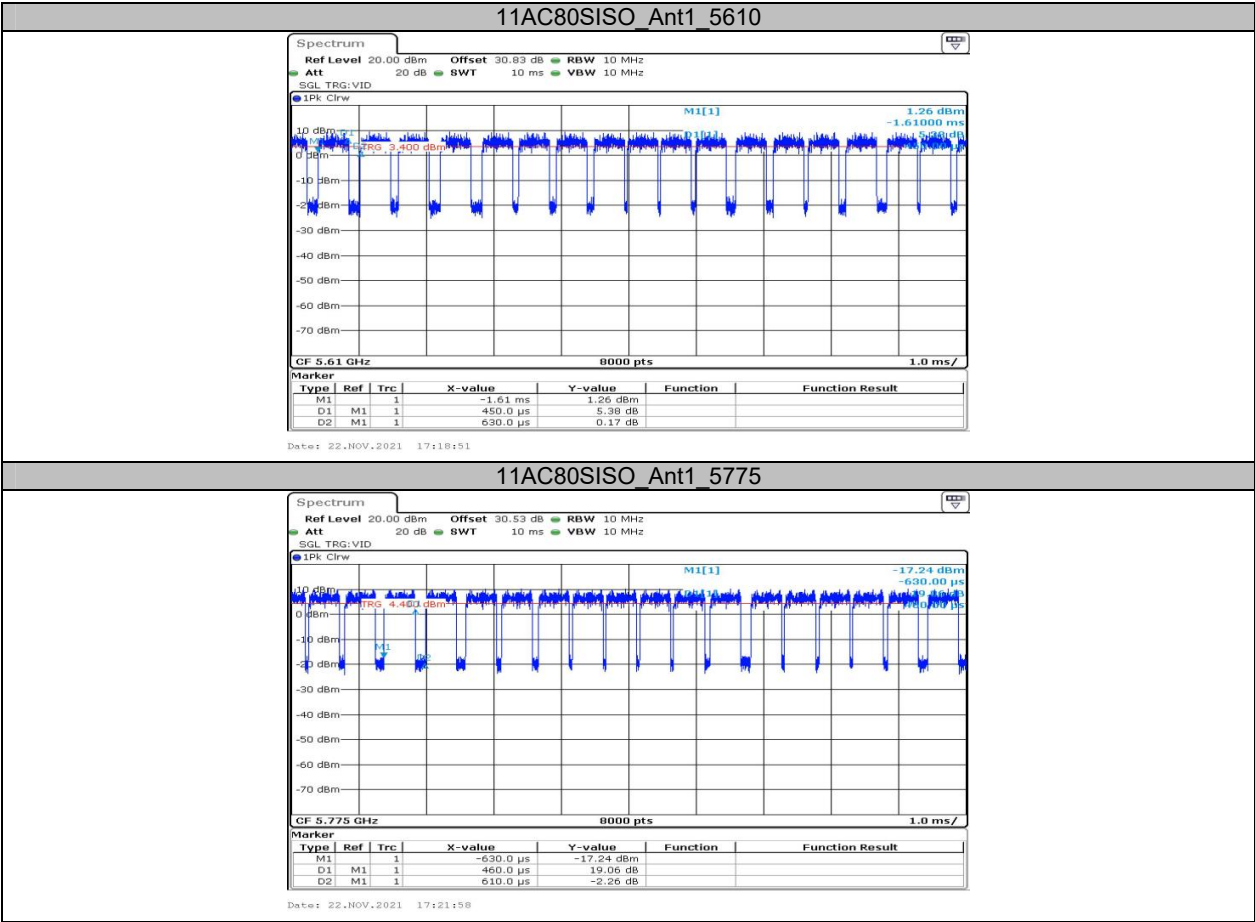

***** END OF REPORT *****