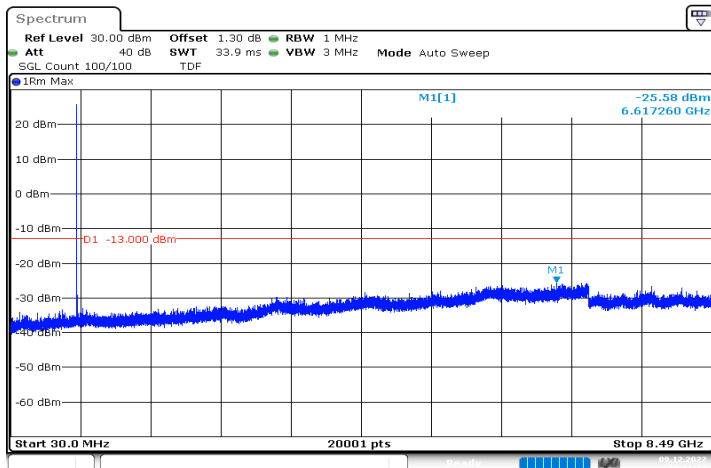


FCC Part 22H**Spurious emissions at antenna terminals****n5 , Normal**

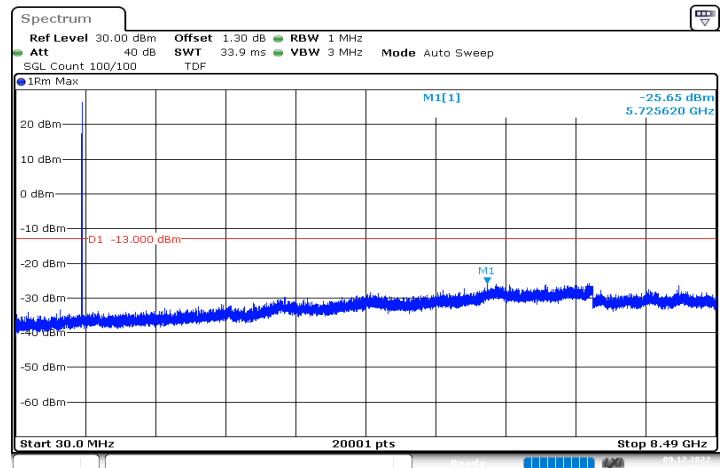
Mode	Value (dBm)	Limit (dBm)	Result
n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.58	-13	Pass
n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_8.49GHz	-25.65	-13	Pass
n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_8.49GHz	-25.64	-13	Pass
n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-17.91	-13	Pass
n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_8.49GHz	-25.72	-13	Pass
n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_8.49GHz	-24.49	-13	Pass
n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-24.82	-13	Pass
n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_8.49GHz	-24.43	-13	Pass
n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_8.49GHz	-25.34	-13	Pass
n5_10MHz_15kHz_829MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.65	-13	Pass
n5_10MHz_15kHz_829MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_8.49GHz	-18.38	-13	Pass
n5_10MHz_15kHz_829MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_8.49GHz	-25.83	-13	Pass
n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.48	-13	Pass
n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_8.49GHz	-25.77	-13	Pass
n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_8.49GHz	-25.9	-13	Pass
n5_10MHz_15kHz_844MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-25.78	-13	Pass
n5_10MHz_15kHz_844MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_8.49GHz	-25.46	-13	Pass
n5_10MHz_15kHz_844MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_8.49GHz	-25.61	-13	Pass
n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-20.43	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_8.49GHz	-25.44	-13	Pass
n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_8.49GHz	-26.05	-13	Pass
n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-20.13	-13	Pass
n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_8.49GHz	-25.89	-13	Pass
n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_8.49GHz	-25.92	-13	Pass
n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_8.49GHz	-24.92	-13	Pass
n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_8.49GHz	-25.9	-13	Pass
n5_20MHz_15kHz_834MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-16.76	-13	Pass
n5_20MHz_15kHz_834MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_8.49GHz	-25.48	-13	Pass
n5_20MHz_15kHz_834MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_8.49GHz	-25.75	-13	Pass
n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-19.19	-13	Pass
n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_8.49GHz	-25.32	-13	Pass
n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_8.49GHz	-24.73	-13	Pass
n5_20MHz_15kHz_839MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-17.84	-13	Pass
n5_20MHz_15kHz_839MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_8.49GHz	-25.66	-13	Pass
n5_20MHz_15kHz_839MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_8.49GHz	-24.28	-13	Pass
n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_8.49GHz	-18.75	-13	Pass

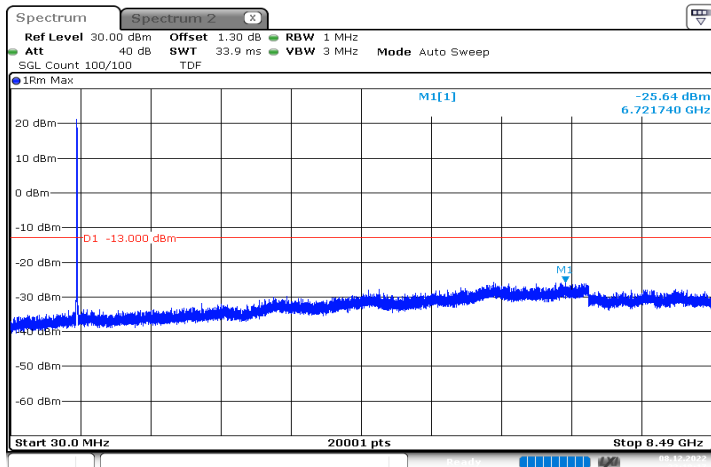
n5 , Normal

n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

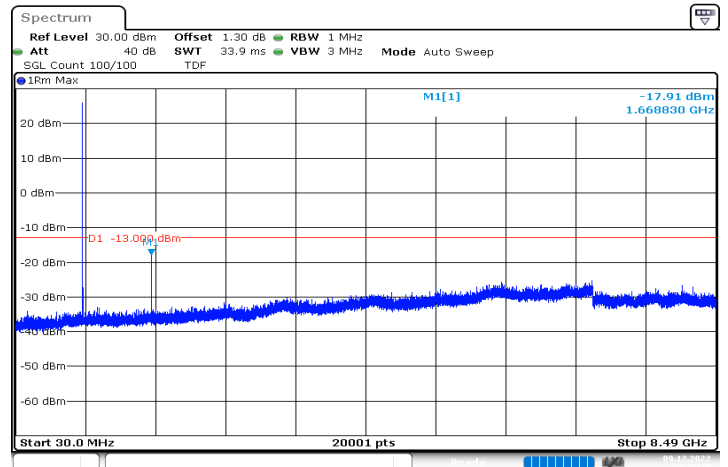
Date: 9.DEC.2022 10:21:23

n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_8.49GHz

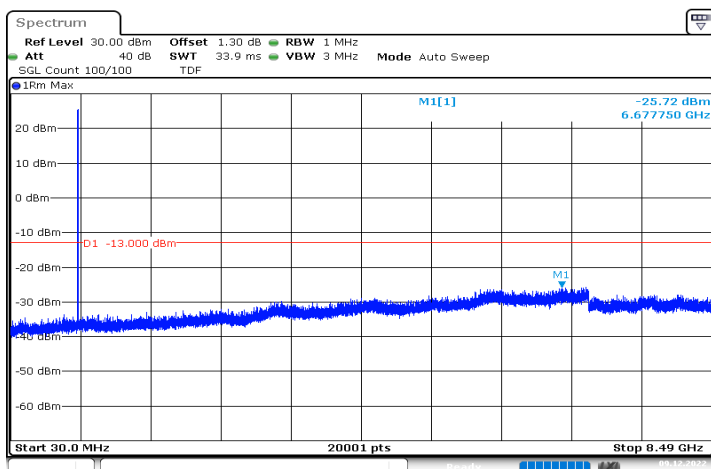
Date: 9.DEC.2022 10:22:07

n5_5MHz_15kHz_826.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_8.49GHz

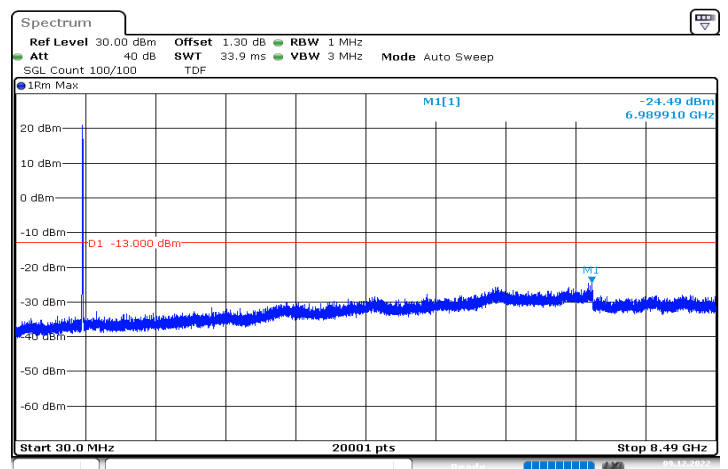
Date: 8.DEC.2022 23:10:17

n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

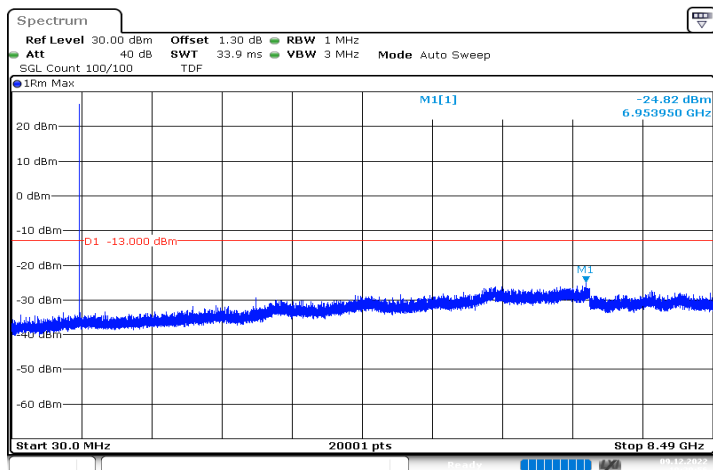
Date: 9.DEC.2022 10:28:28

n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_8.49GHz

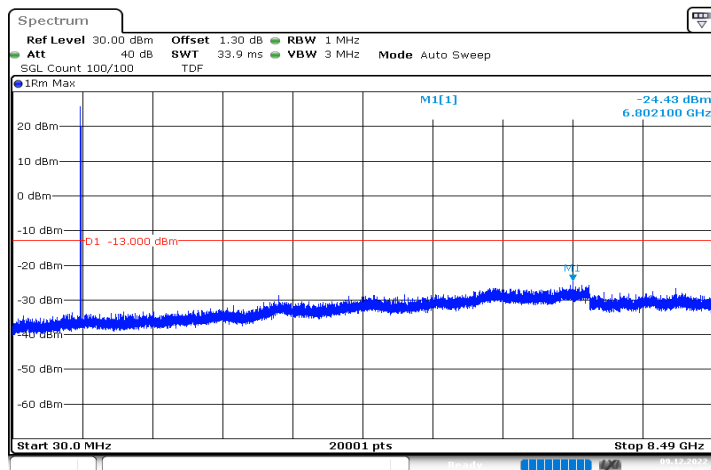
Date: 9.DEC.2022 10:20:53

n5_5MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_8.49GHz

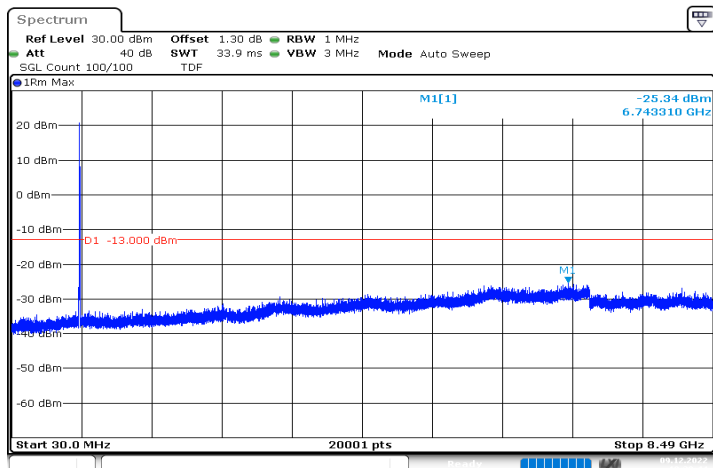
Date: 9.DEC.2022 10:29:18

n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

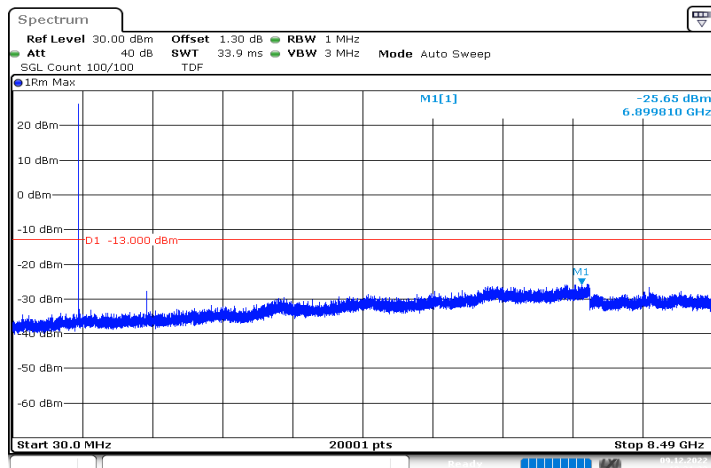
Date: 9.DEC.2022 10:29:56

n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_8.49GHz

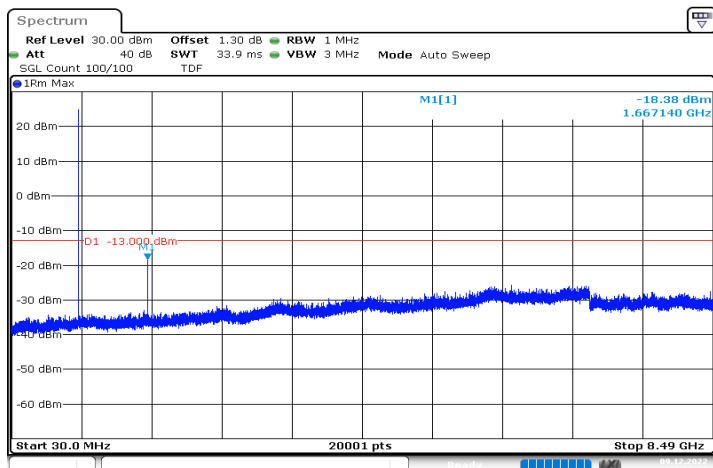
Date: 9.DEC.2022 10:30:20

n5_5MHz_15kHz_846.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_8.49GHz

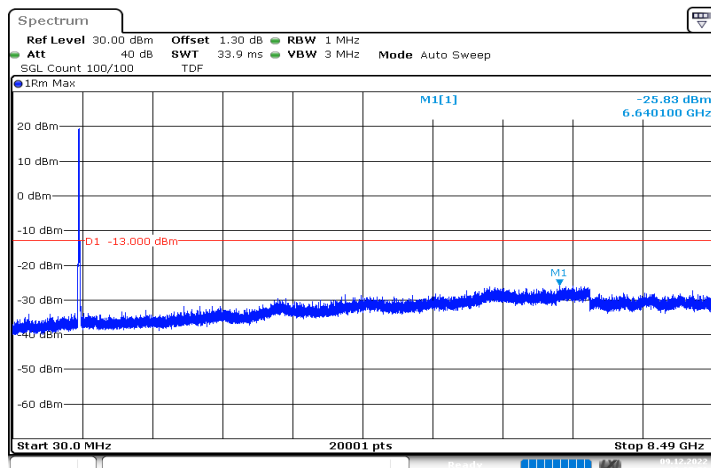
Date: 9.DEC.2022 10:30:44

n5_10MHz_15kHz_829MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

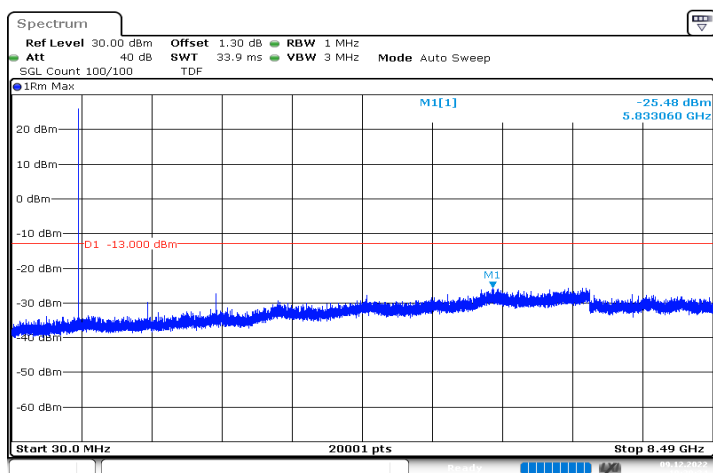
Date: 9.DEC.2022 10:31:22

n5_10MHz_15kHz_829MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_8.49GHz

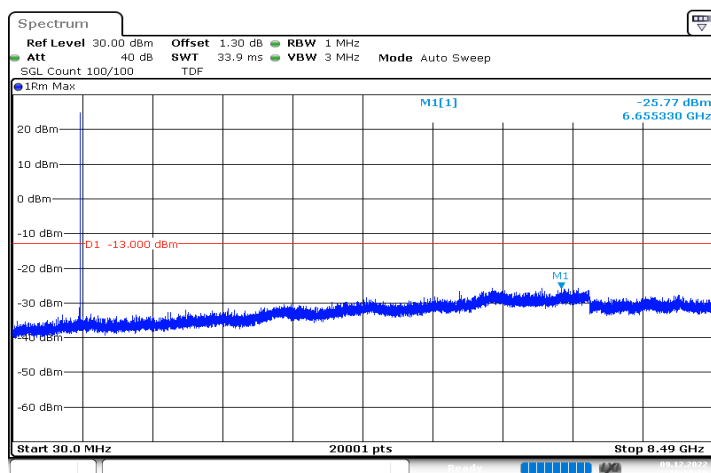
Date: 9.DEC.2022 10:32:52

n5_10MHz_15kHz_829MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_8.49GHz

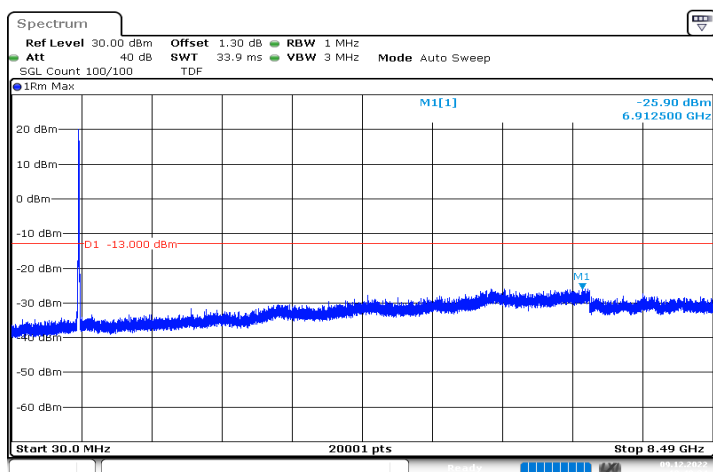
Date: 9.DEC.2022 10:37:56

n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

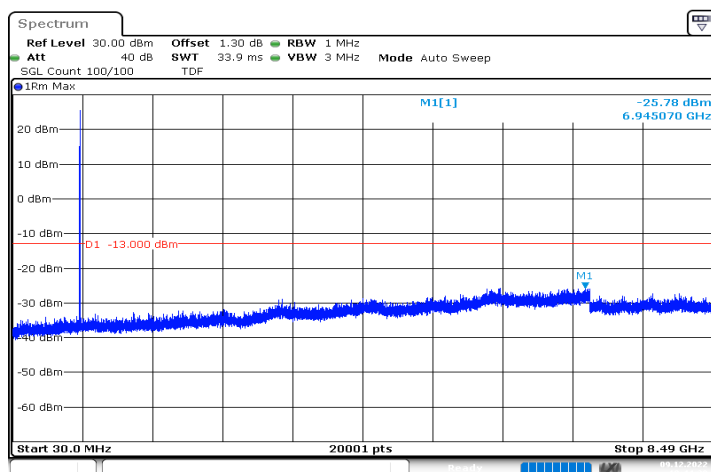
Date: 9.DEC.2022 10:39:33

n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_8.49GHz

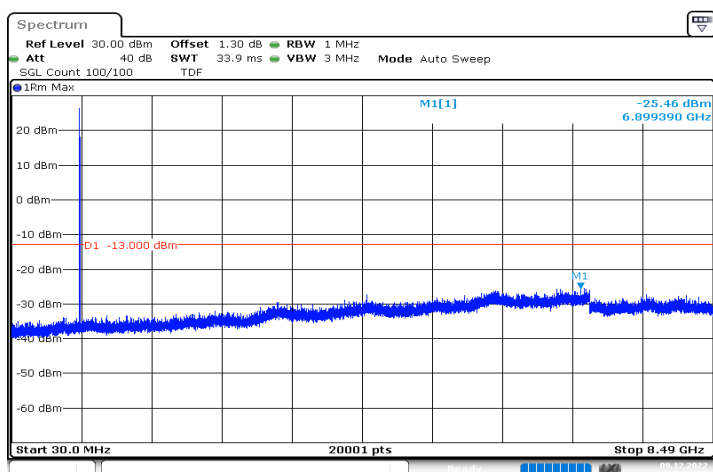
Date: 9.DEC.2022 10:39:59

n5_10MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_8.49GHz

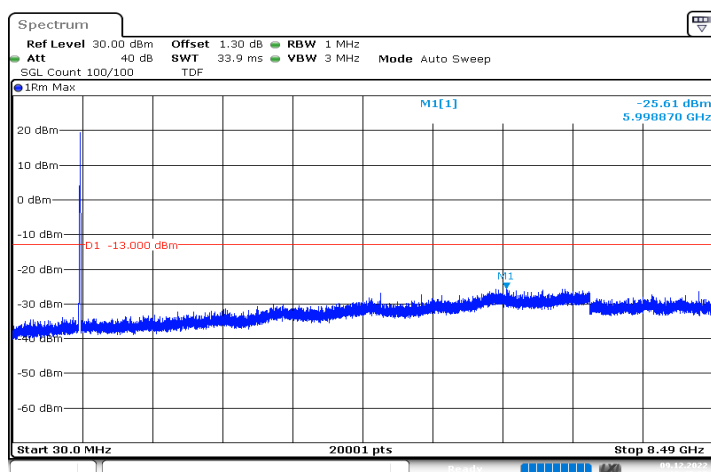
Date: 9.DEC.2022 10:40:24

n5_10MHz_15kHz_844MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

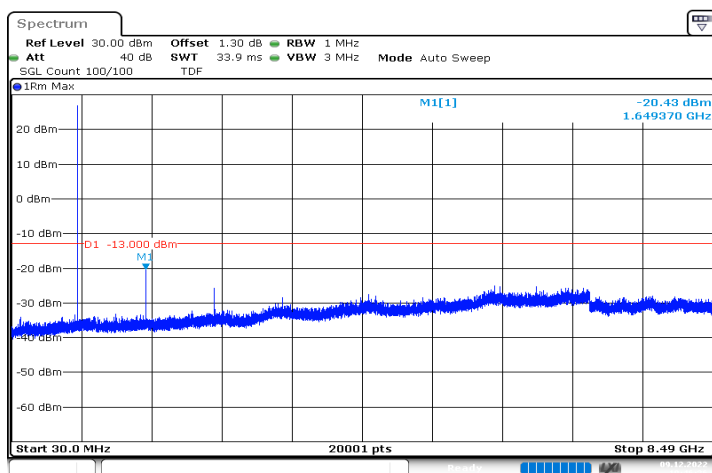
Date: 9.DEC.2022 10:44:39

n5_10MHz_15kHz_844MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_8.49GHz

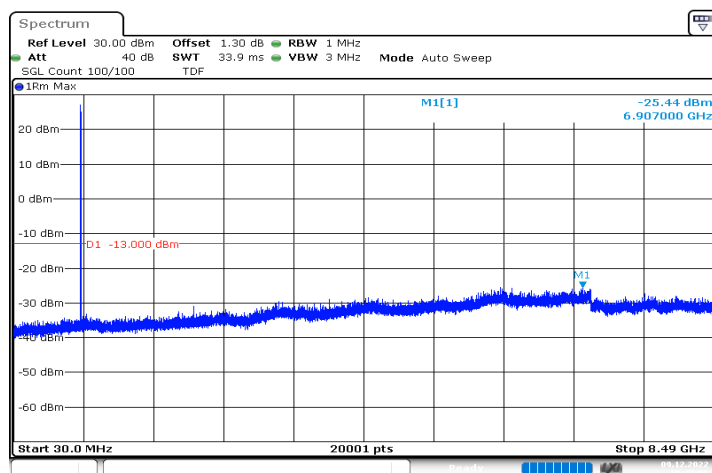
Date: 9.DEC.2022 10:45:08

n5_10MHz_15kHz_844MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_8.49GHz

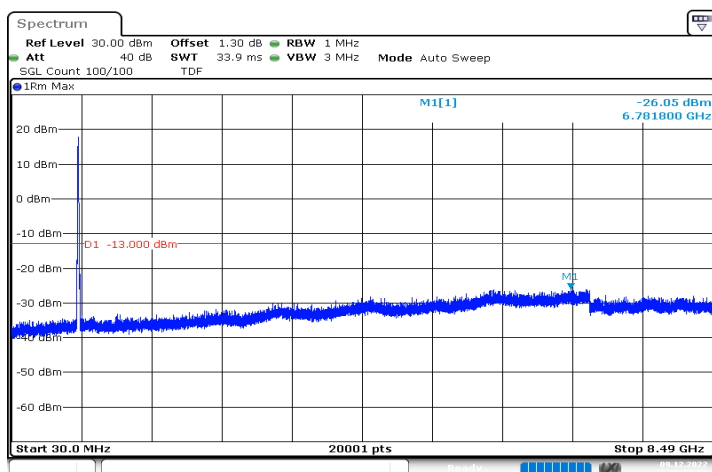
Date: 9.DEC.2022 10:45:37

n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

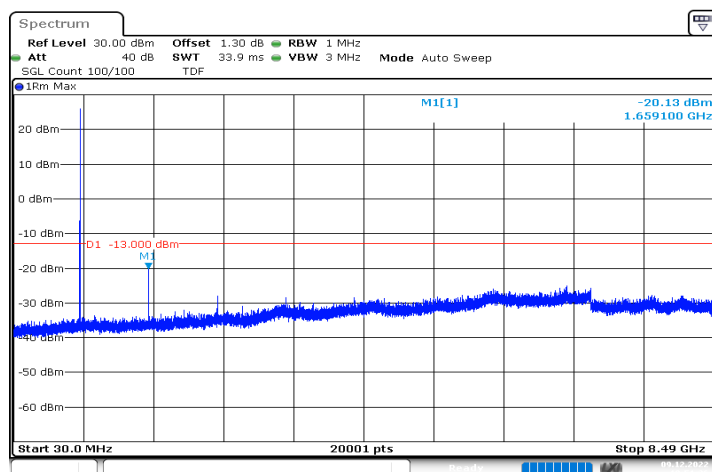
Date: 9.DEC.2022 10:46:26

n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_8.49GHz

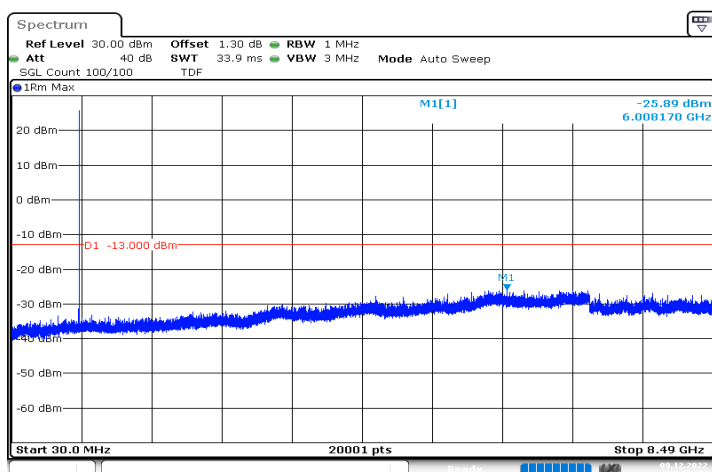
Date: 9.DEC.2022 10:47:06

n5_15MHz_15kHz_831.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_8.49GHz

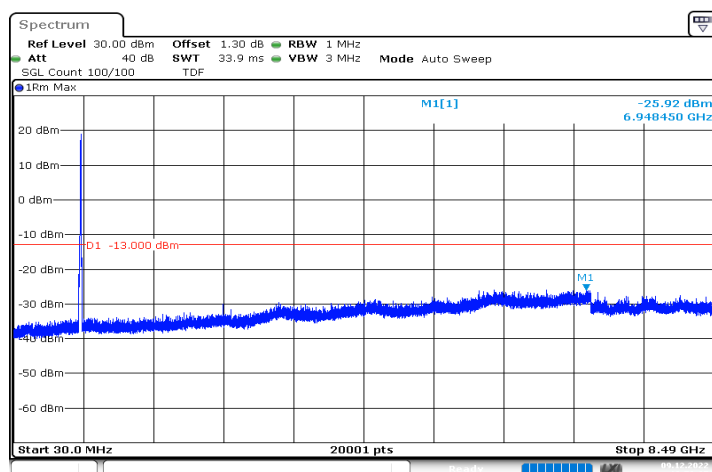
Date: 9.DEC.2022 10:50:51

n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

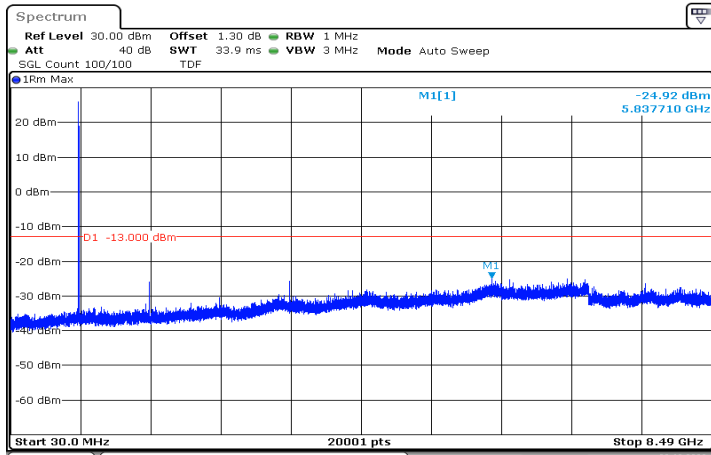
Date: 9.DEC.2022 10:51:25

n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_8.49GHz

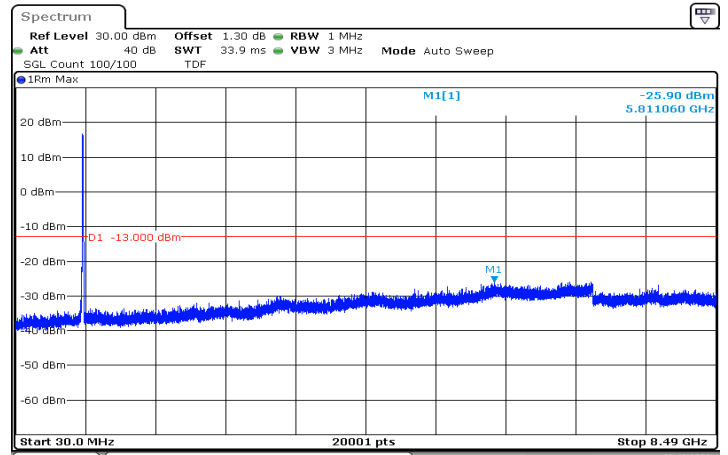
Date: 9.DEC.2022 10:51:54

n5_15MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_8.49GHz

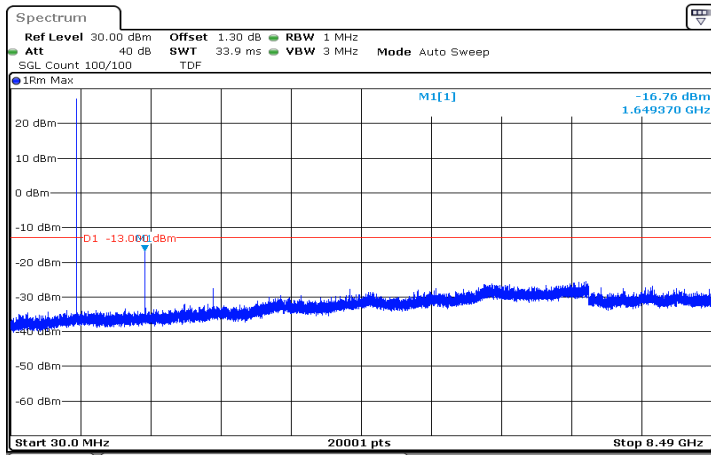
Date: 9.DEC.2022 10:52:25

n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_8.49GHz

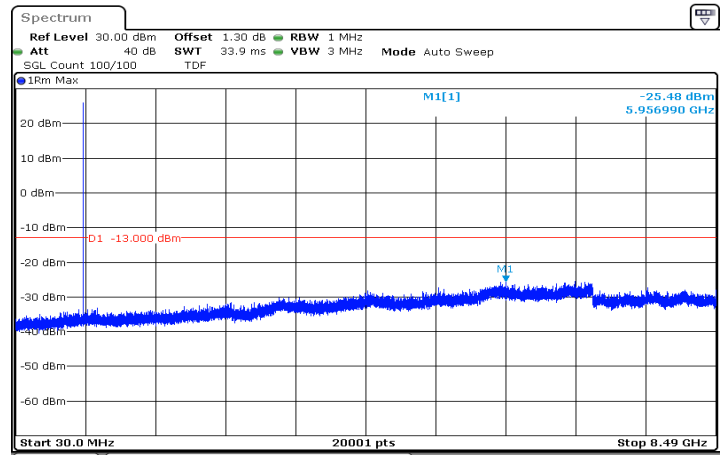
Date: 9.DEC.2022 11:19:03

n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_8.49GHz

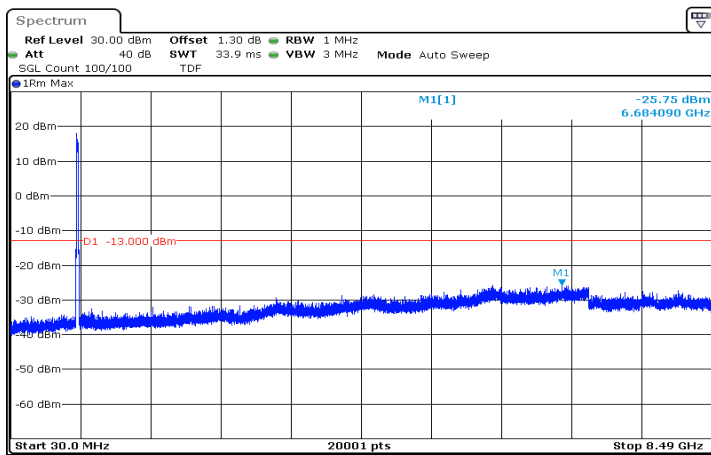
Date: 9.DEC.2022 11:19:44

n5_20MHz_15kHz_834MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

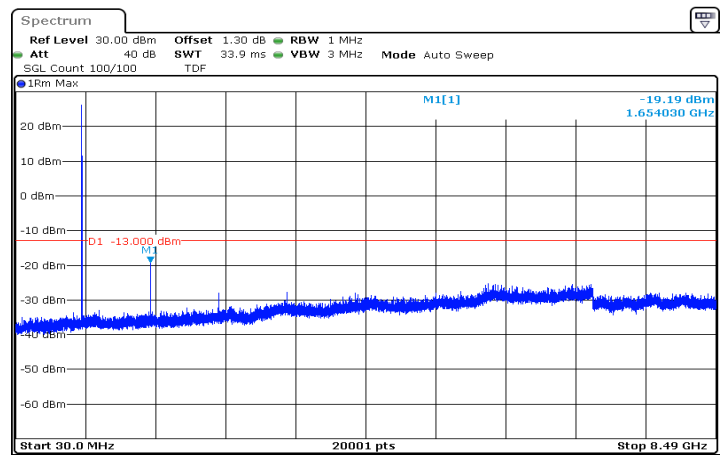
Date: 9.DEC.2022 11:22:52

n5_20MHz_15kHz_834MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_8.49GHz

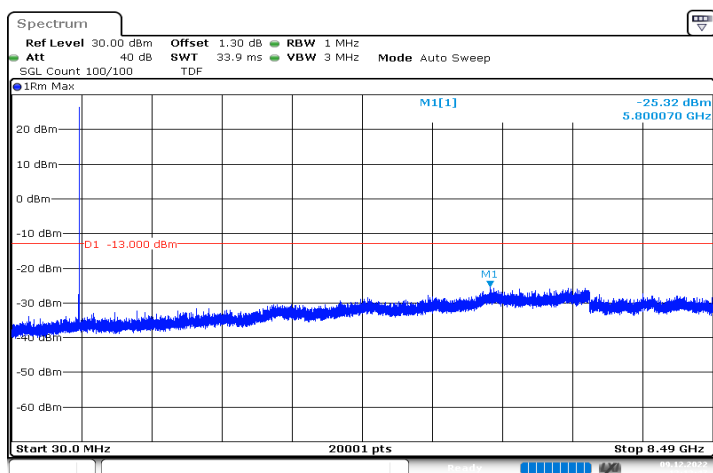
Date: 9.DEC.2022 11:23:21

n5_20MHz_15kHz_834MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_8.49GHz

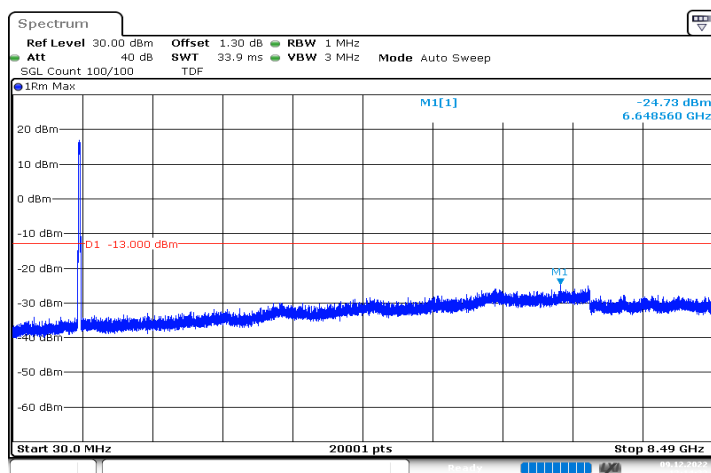
Date: 9.DEC.2022 11:23:53

n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

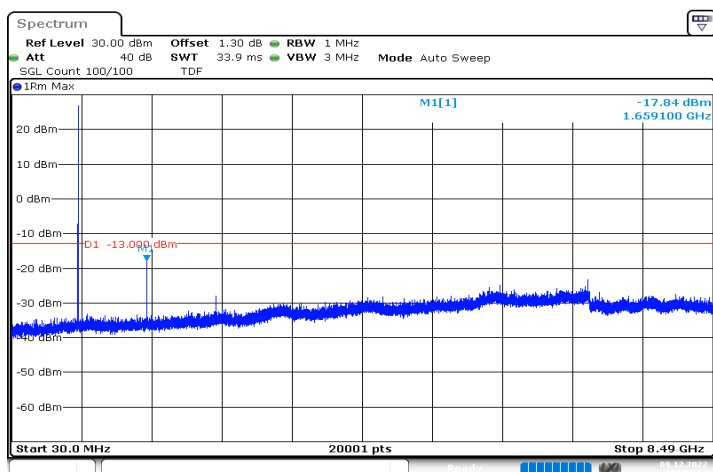
Date: 9.DEC.2022 13:11:03

n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_8.49GHz

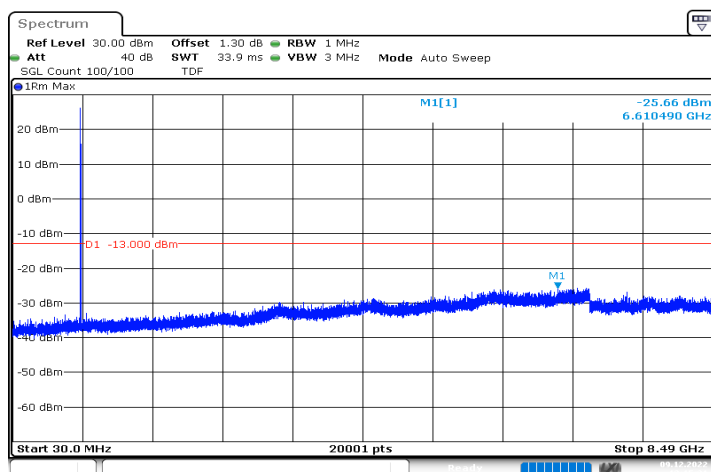
Date: 9.DEC.2022 13:12:47

n5_20MHz_15kHz_836.5MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_8.49GHz

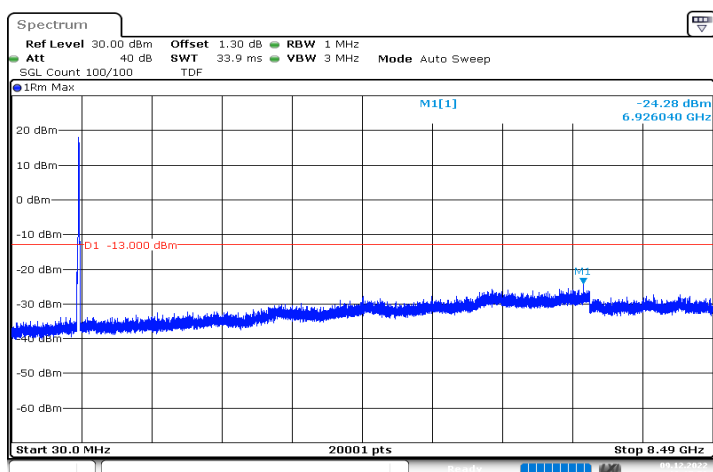
Date: 9.DEC.2022 13:14:32

n5_20MHz_15kHz_839MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

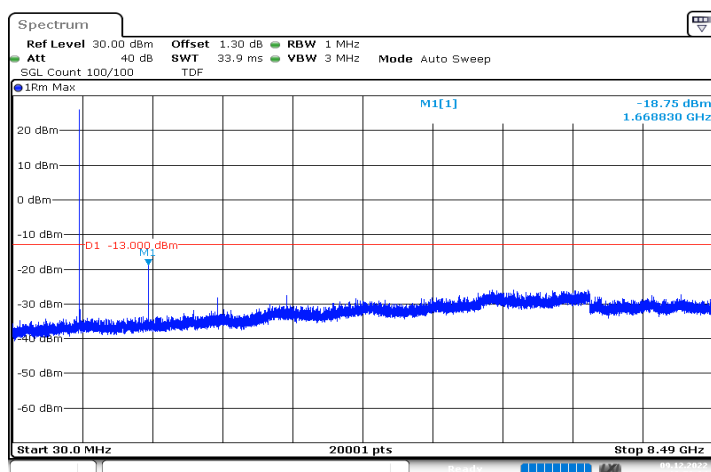
Date: 9.DEC.2022 13:15:04

n5_20MHz_15kHz_839MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_8.49GHz

Date: 9.DEC.2022 13:15:31

n5_20MHz_15kHz_839MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_8.49GHz

Date: 9.DEC.2022 13:15:59

n5_15MHz_15kHz_841.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_8.49GHz

Date: 9.DEC.2022 10:53:04