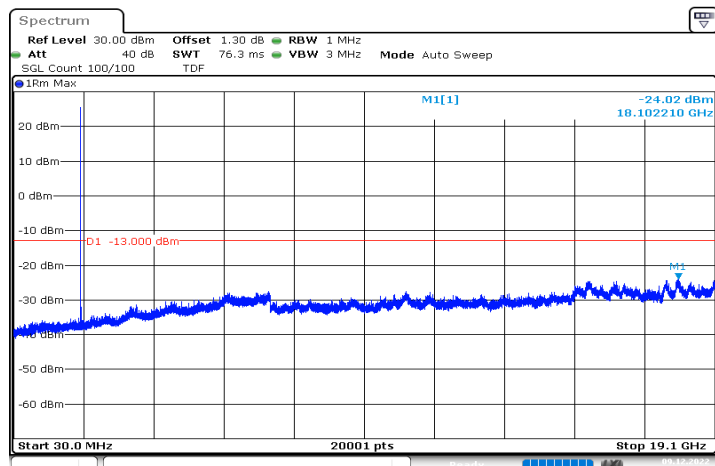


FCC Part 24E**Spurious emissions at antenna terminals****n2 , Normal**

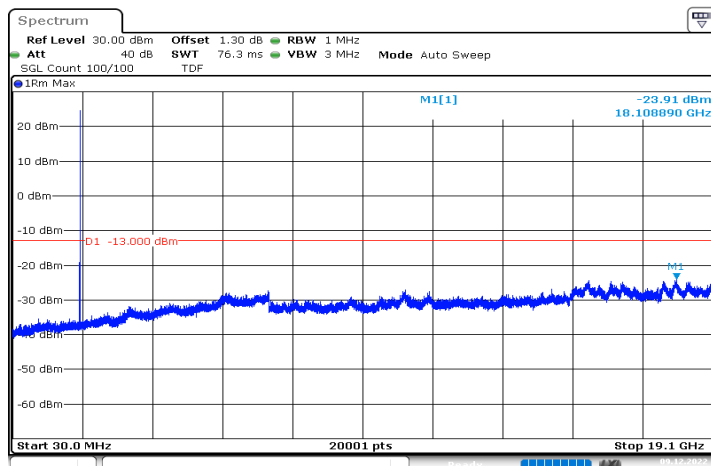
Mode	Value (dBm)	Limit (dBm)	Result
n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-24.02	-13	Pass
n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_19.1GHz	-23.91	-13	Pass
n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_19.1GHz	-23.85	-13	Pass
n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-23.48	-13	Pass
n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_19.1GHz	-24.13	-13	Pass
n2_5MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_19.1GHz	-23.96	-13	Pass
n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-23.93	-13	Pass
n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB1@24 30MHz_19.1GHz	-23.73	-13	Pass
n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM QPSK_RB25@0 30MHz_19.1GHz	-23.96	-13	Pass
n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-23.26	-13	Pass
n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_19.1GHz	-24.07	-13	Pass
n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_19.1GHz	-23.54	-13	Pass
n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-23.75	-13	Pass
n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_19.1GHz	-24.31	-13	Pass
n2_10MHz_15kHz_1905MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_19.1GHz	-23.81	-13	Pass
n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-23.91	-13	Pass
n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_19.1GHz	-23.97	-13	Pass
n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-24.15	-13	Pass
n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_19.1GHz	-23.9	-13	Pass

Mode	Value (dBm)	Limit (dBm)	Result
n2_20MHz_15kHz_1860MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_19.1GHz	-23.78	-13	Pass
n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-23.64	-13	Pass
n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_19.1GHz	-24.11	-13	Pass
n2_20MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_19.1GHz	-22.51	-13	Pass
n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-24.02	-13	Pass
n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB1@105 30MHz_19.1GHz	-23.29	-13	Pass
n2_20MHz_15kHz_1900MHz_DFT-s-OFDM QPSK_RB100@0 30MHz_19.1GHz	-23.78	-13	Pass
n2_10MHz_15kHz_1855MHz_DFT-s-OFDM QPSK_RB50@0 30MHz_19.1GHz	-23.14	-13	Pass
n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-23.83	-13	Pass
n2_10MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@51 30MHz_19.1GHz	-23.87	-13	Pass
n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_19.1GHz	-23.59	-13	Pass
n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-23.92	-13	Pass
n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_19.1GHz	-24.02	-13	Pass
n2_15MHz_15kHz_1880MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_19.1GHz	-24.2	-13	Pass
n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB1@0 30MHz_19.1GHz	-23.08	-13	Pass
n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB1@78 30MHz_19.1GHz	-23.68	-13	Pass
n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM QPSK_RB75@0 30MHz_19.1GHz	-24.01	-13	Pass

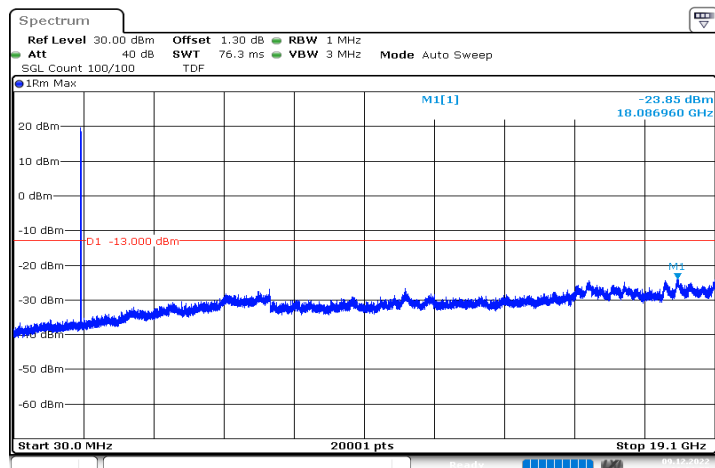
n2 , Normal

n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

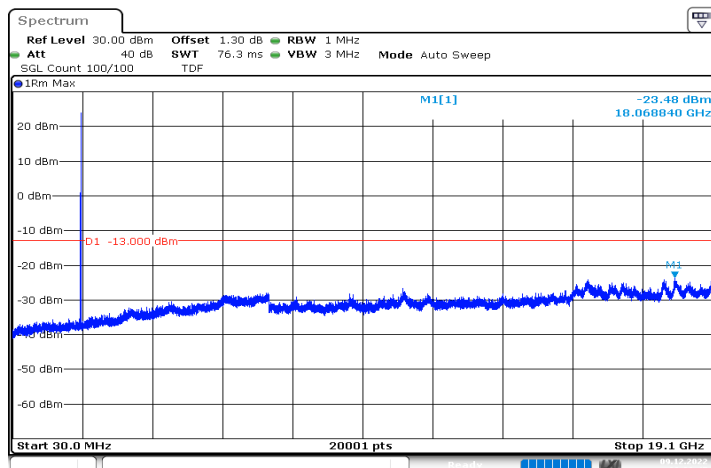
Date: 9.DEC.2022 09:17:39

n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_19.1GHz

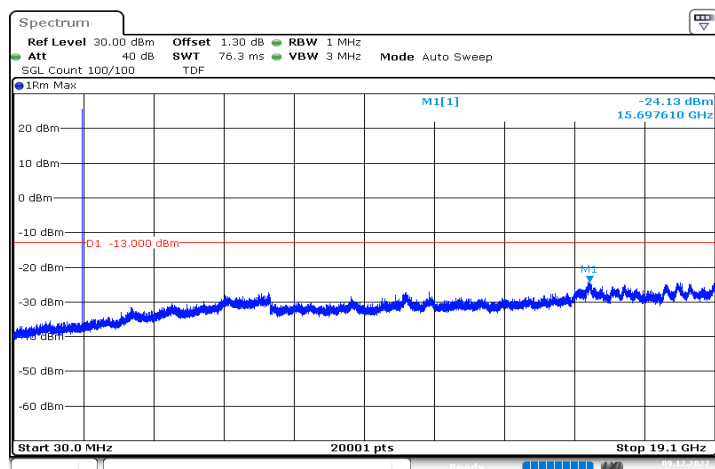
Date: 9.DEC.2022 09:18:22

n2_5MHz_15kHz_1852.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_19.1GHz

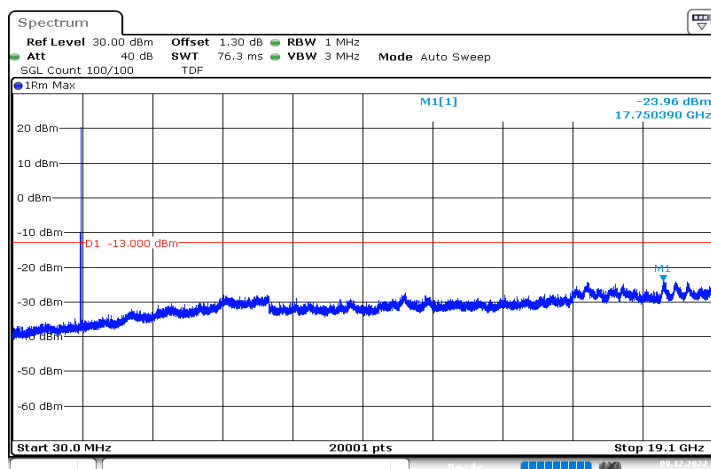
Date: 9.DEC.2022 09:21:55

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

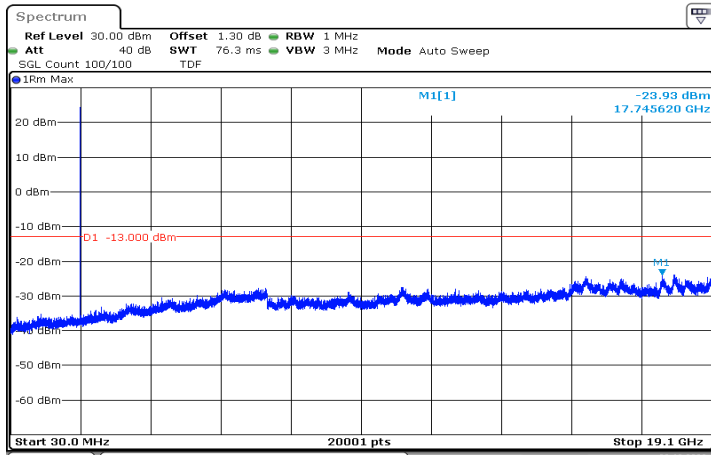
Date: 9.DEC.2022 09:22:47

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_19.1GHz

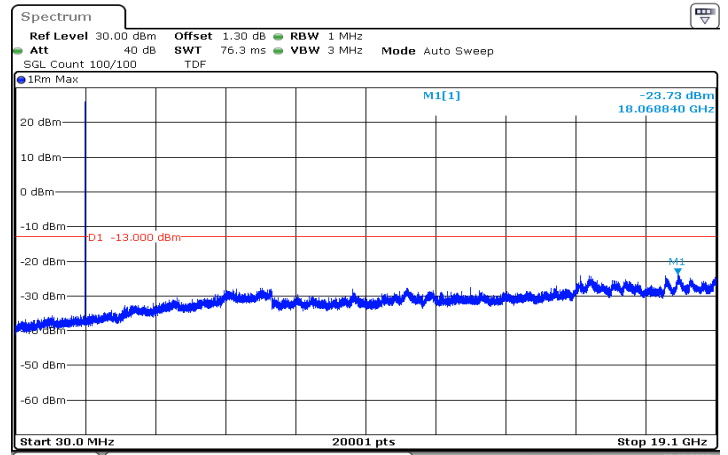
Date: 9.DEC.2022 09:23:31

n2_5MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_19.1GHz

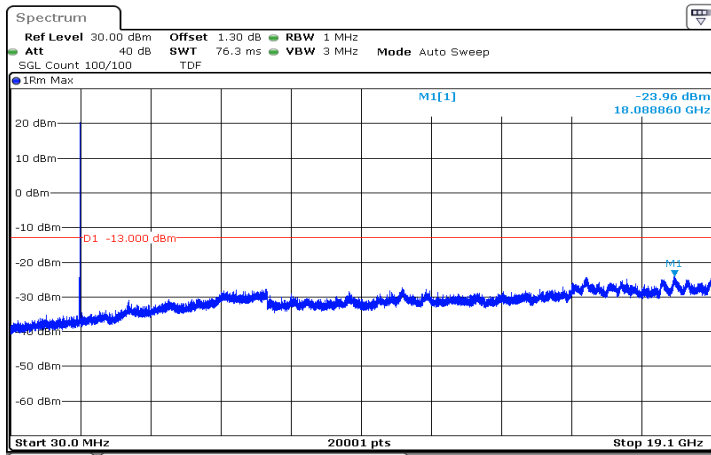
Date: 9.DEC.2022 09:24:15

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

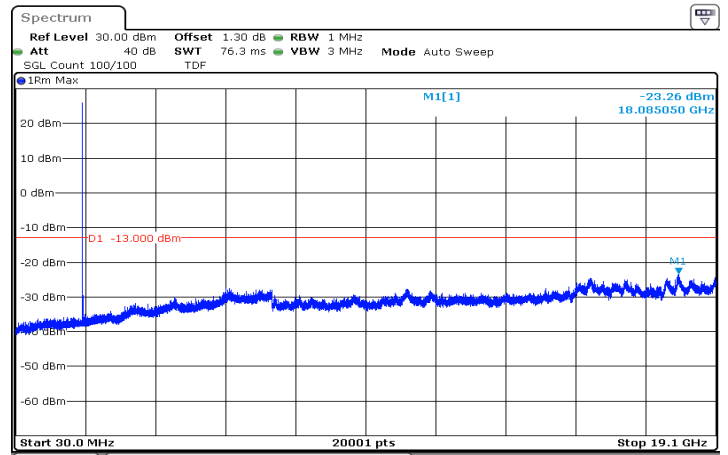
Date: 9.DEC.2022 09:29:04

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB1@24|30MHz_19.1GHz

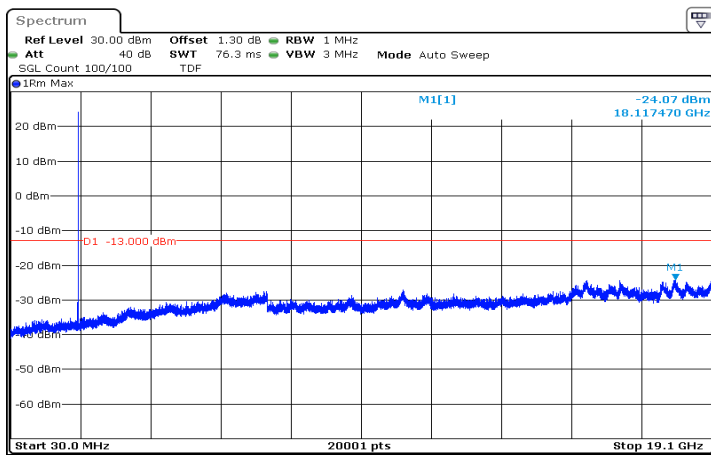
Date: 9.DEC.2022 09:29:51

n2_5MHz_15kHz_1907.5MHz_DFT-s-OFDM
QPSK_RB25@0|30MHz_19.1GHz

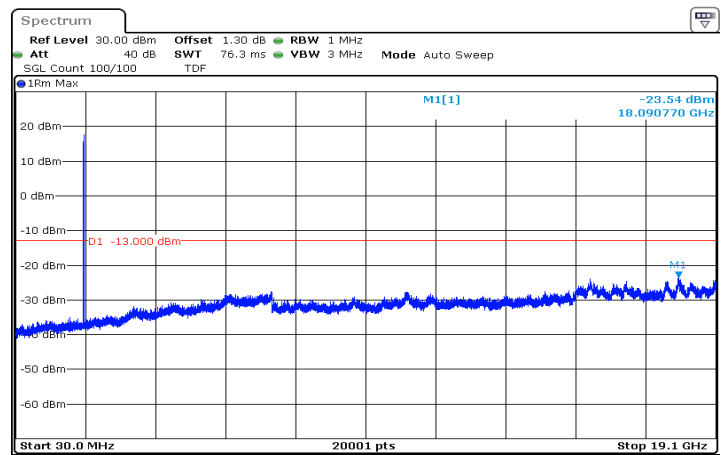
Date: 9.DEC.2022 09:30:44

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

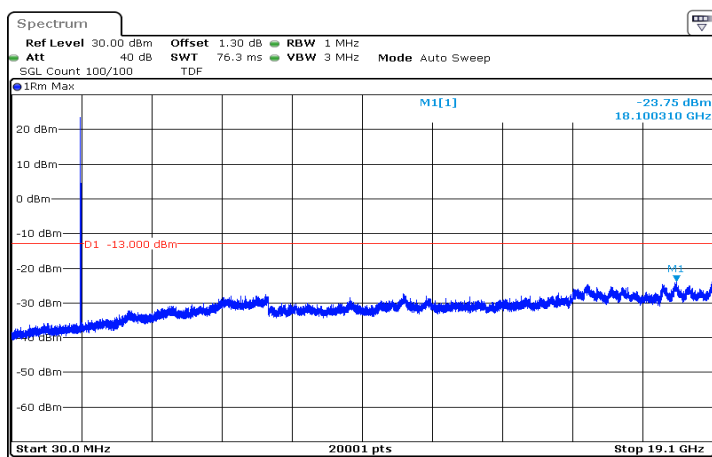
Date: 9.DEC.2022 09:32:39

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_19.1GHz

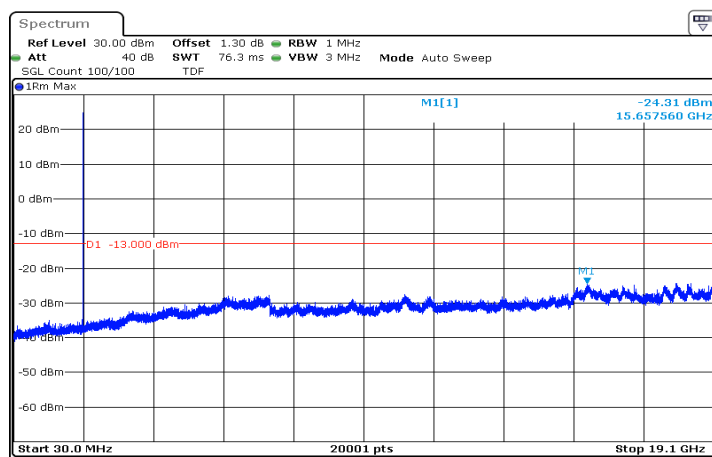
Date: 9.DEC.2022 09:33:24

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_19.1GHz

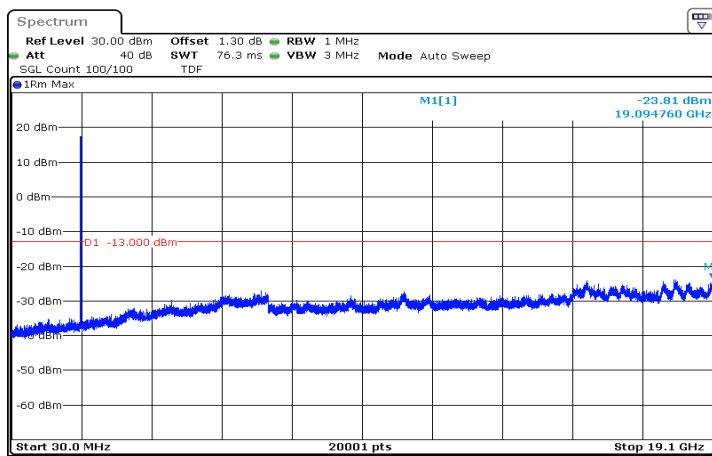
Date: 9.DEC.2022 09:36:35

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

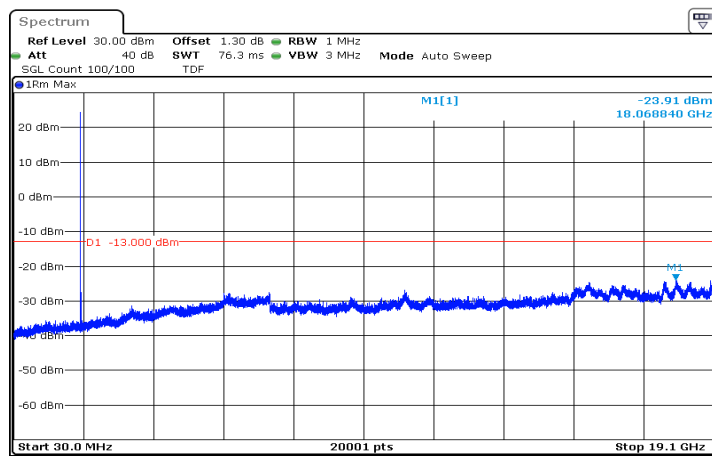
Date: 9.DEC.2022 09:37:27

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_19.1GHz

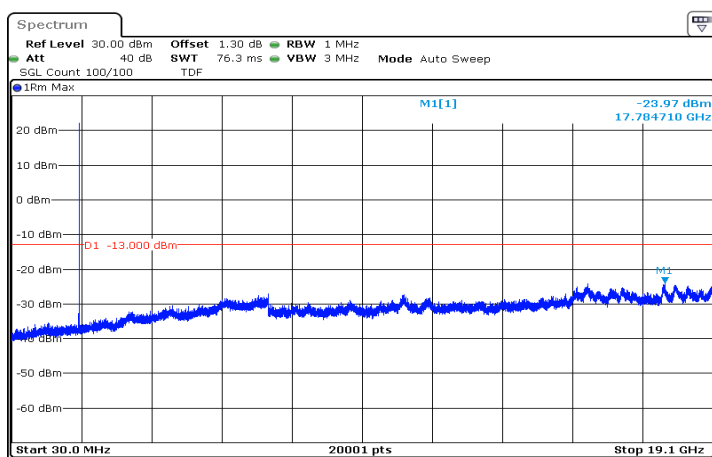
Date: 9.DEC.2022 09:38:12

n2_10MHz_15kHz_1905MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_19.1GHz

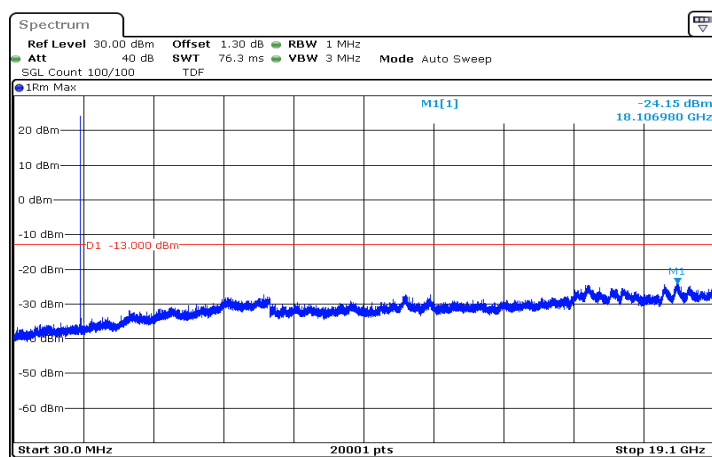
Date: 9.DEC.2022 09:38:57

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

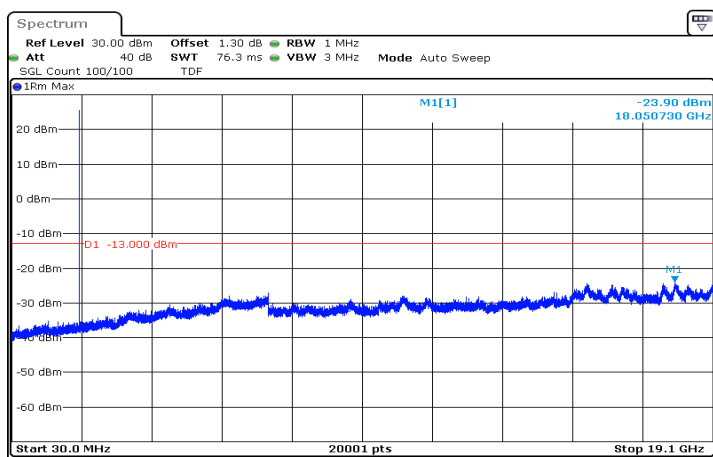
Date: 9.DEC.2022 09:39:59

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_19.1GHz

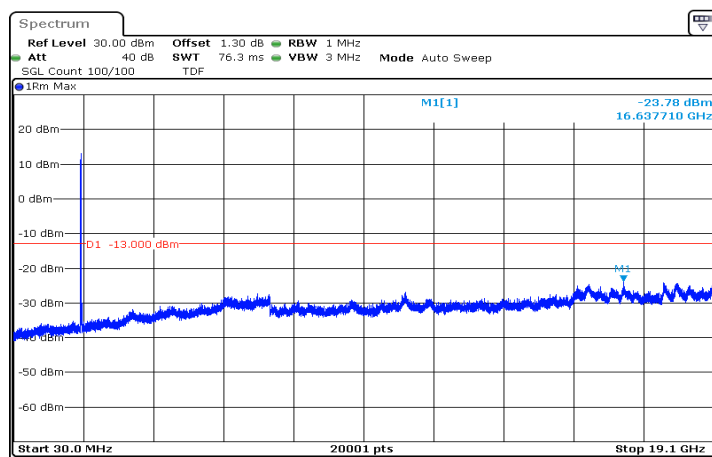
Date: 9.DEC.2022 09:42:08

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

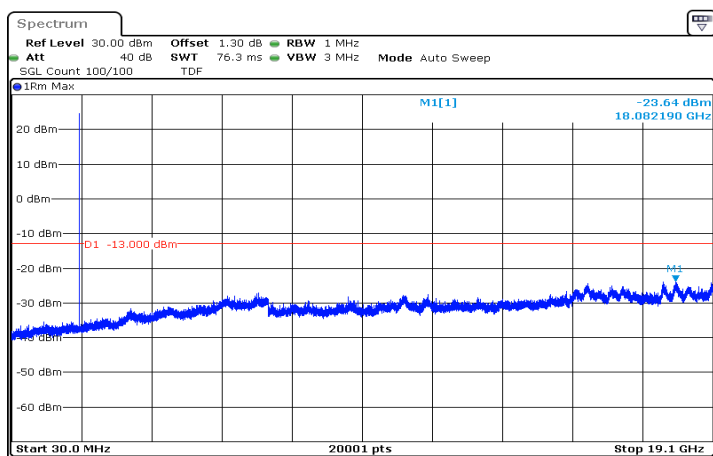
Date: 9.DEC.2022 09:59:52

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_19.1GHz

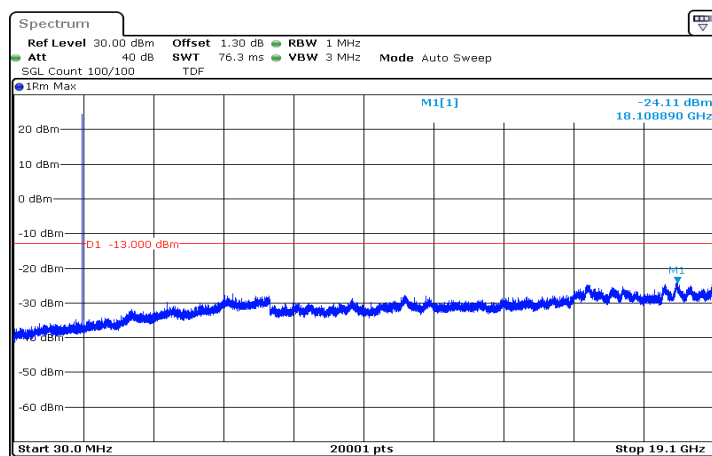
Date: 9.DEC.2022 10:02:00

n2_20MHz_15kHz_1860MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_19.1GHz

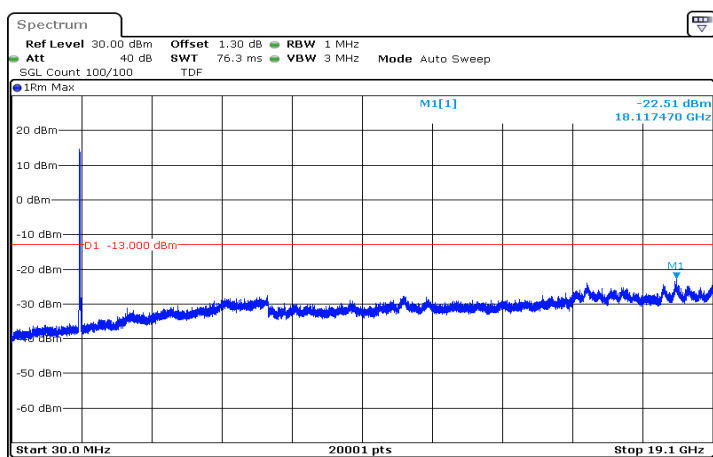
Date: 9.DEC.2022 10:02:50

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

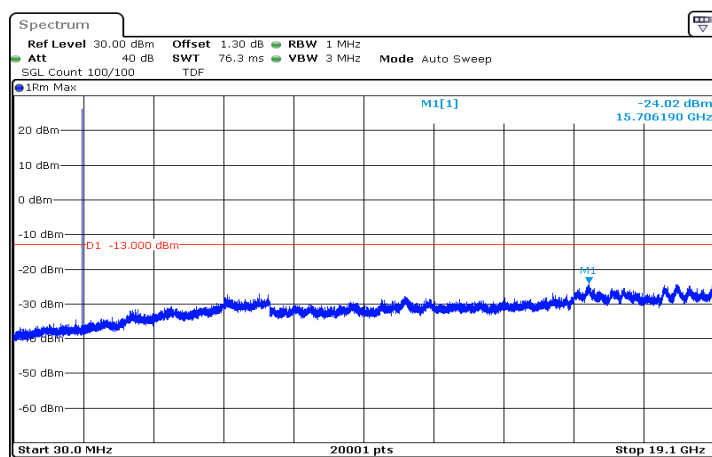
Date: 9.DEC.2022 10:17:01

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_19.1GHz

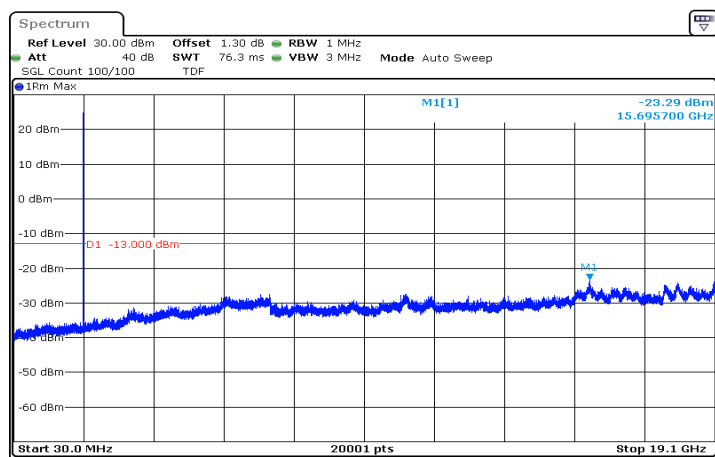
Date: 9.DEC.2022 10:17:40

n2_20MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_19.1GHz

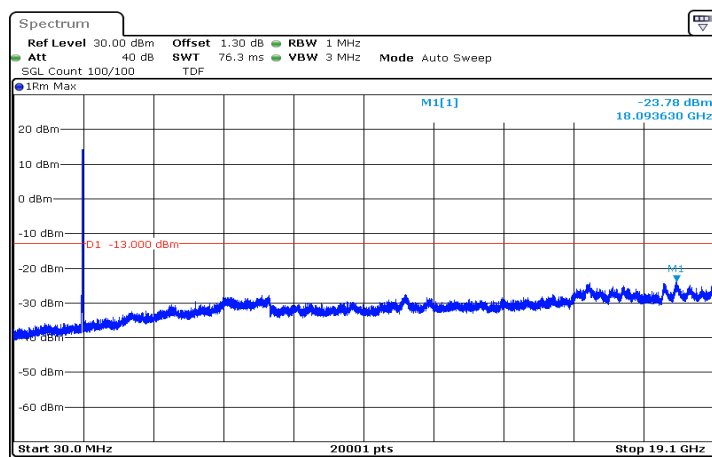
Date: 9.DEC.2022 10:18:29

n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

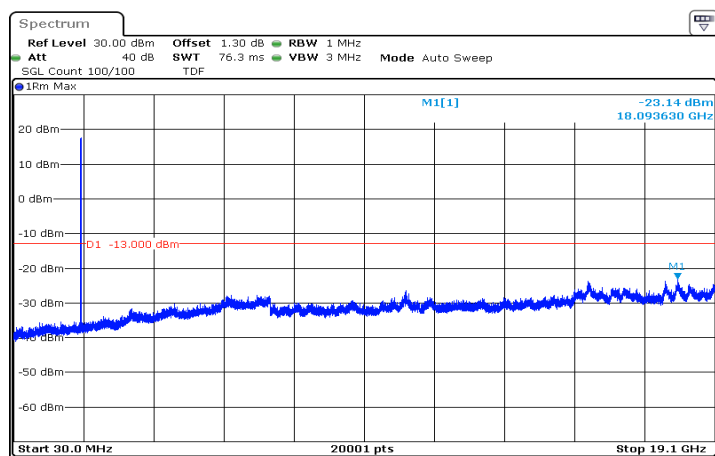
Date: 9.DEC.2022 10:19:17

n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB1@105|30MHz_19.1GHz

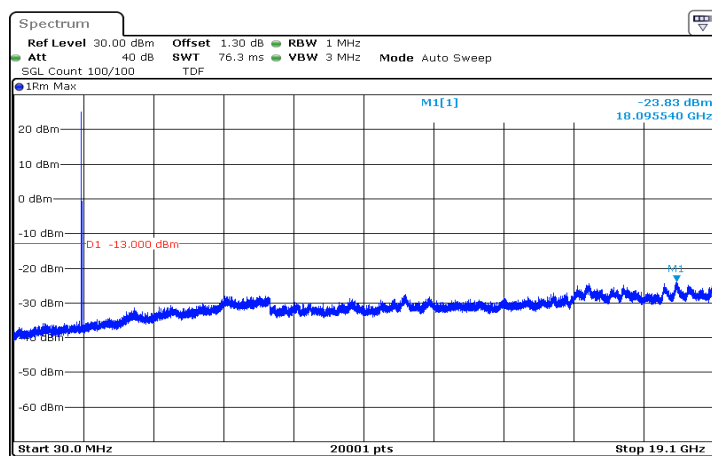
Date: 9.DEC.2022 10:19:59

n2_20MHz_15kHz_1900MHz_DFT-s-OFDM
QPSK_RB100@0|30MHz_19.1GHz

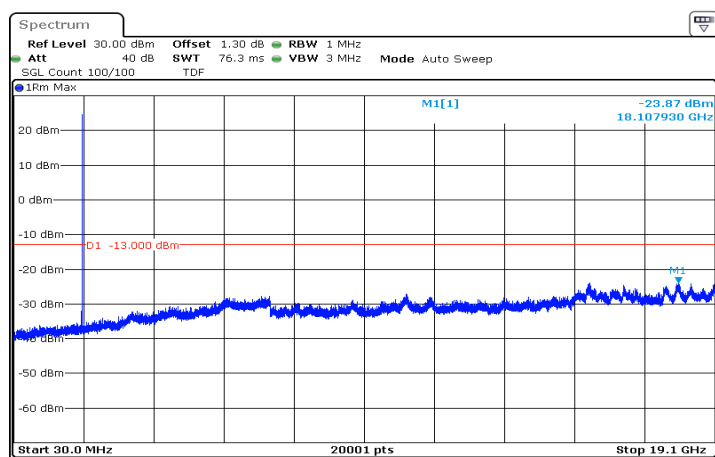
Date: 9.DEC.2022 10:20:42

n2_10MHz_15kHz_1855MHz_DFT-s-OFDM
QPSK_RB50@0|30MHz_19.1GHz

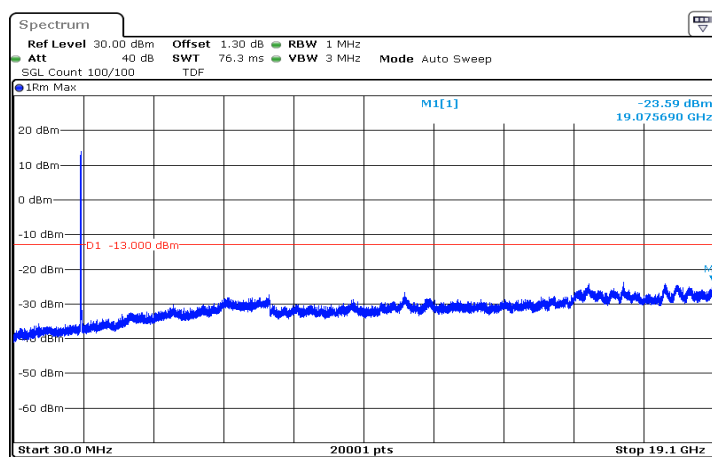
Date: 9.DEC.2022 09:34:08

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

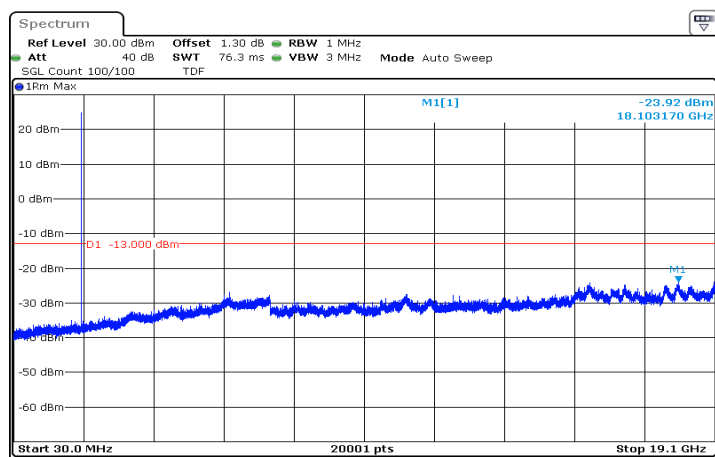
Date: 9.DEC.2022 09:35:00

n2_10MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@51|30MHz_19.1GHz

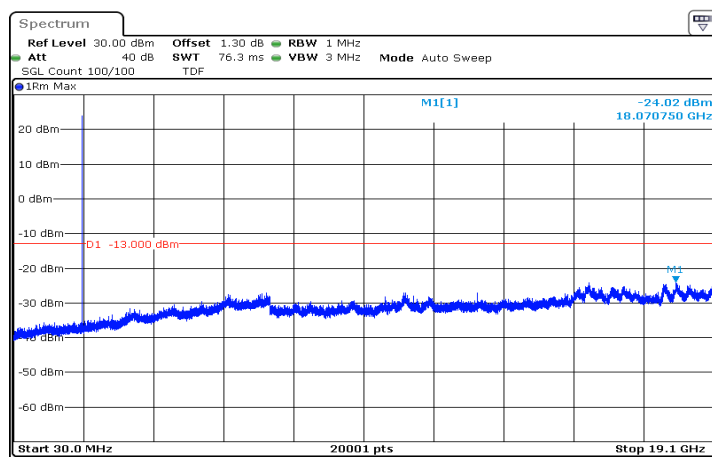
Date: 9.DEC.2022 09:35:46

n2_15MHz_15kHz_1857.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_19.1GHz

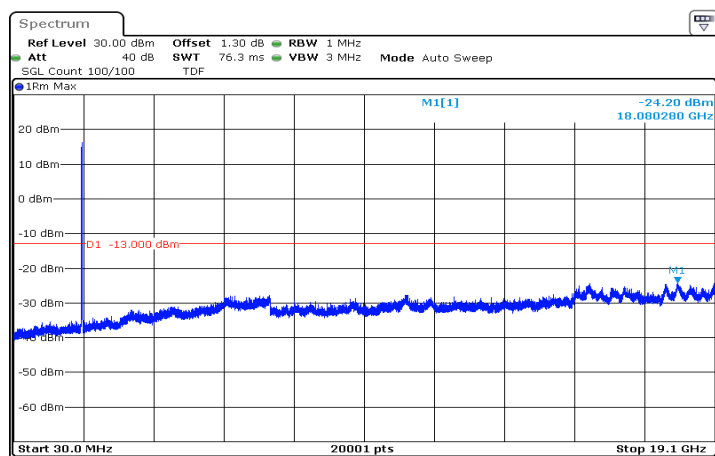
Date: 9.DEC.2022 09:43:37

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

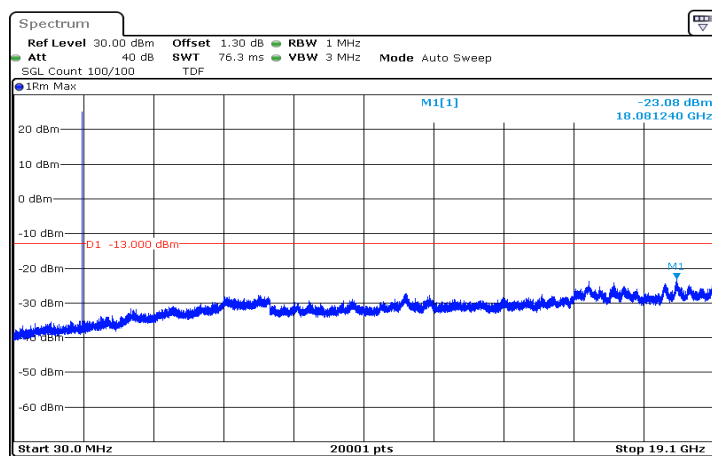
Date: 9.DEC.2022 09:55:13

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_19.1GHz

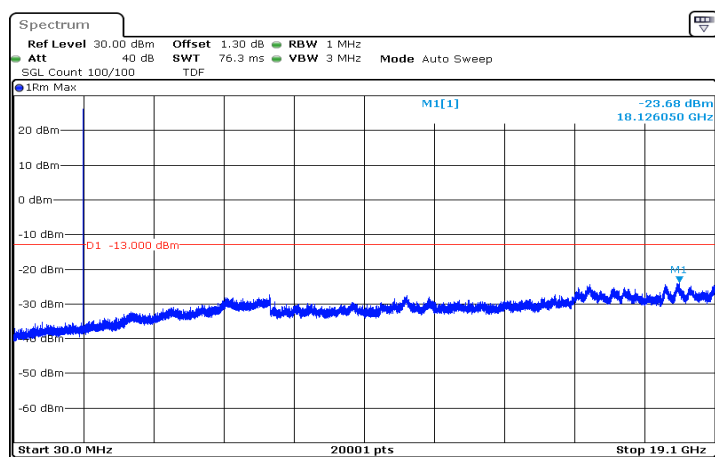
Date: 9.DEC.2022 09:55:57

n2_15MHz_15kHz_1880MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_19.1GHz

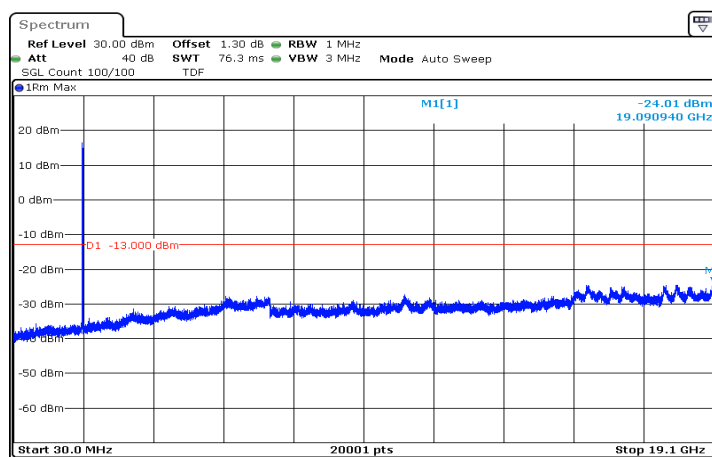
Date: 9.DEC.2022 09:56:40

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB1@0|30MHz_19.1GHz

Date: 9.DEC.2022 09:57:30

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB1@78|30MHz_19.1GHz

Date: 9.DEC.2022 09:58:12

n2_15MHz_15kHz_1902.5MHz_DFT-s-OFDM
QPSK_RB75@0|30MHz_19.1GHz

Date: 9.DEC.2022 09:58:55