





Restrict Band NVNT ac40 5795MHz Ant1 Peak

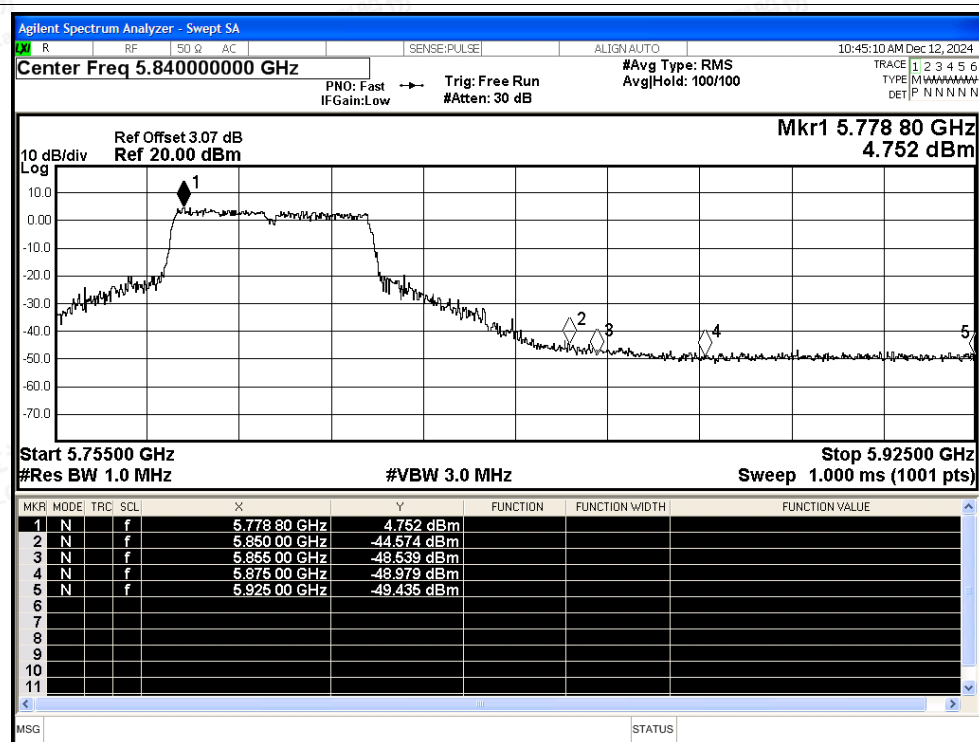

Restrict Band NVNT ac40 5795MHz Ant1 Average

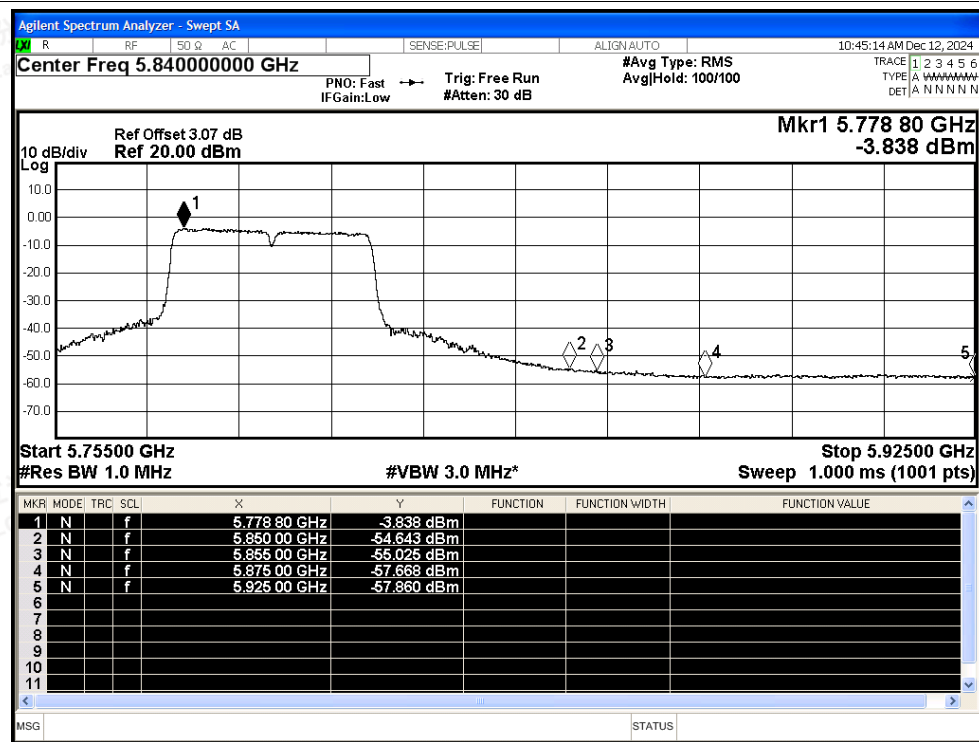

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant1 Peak

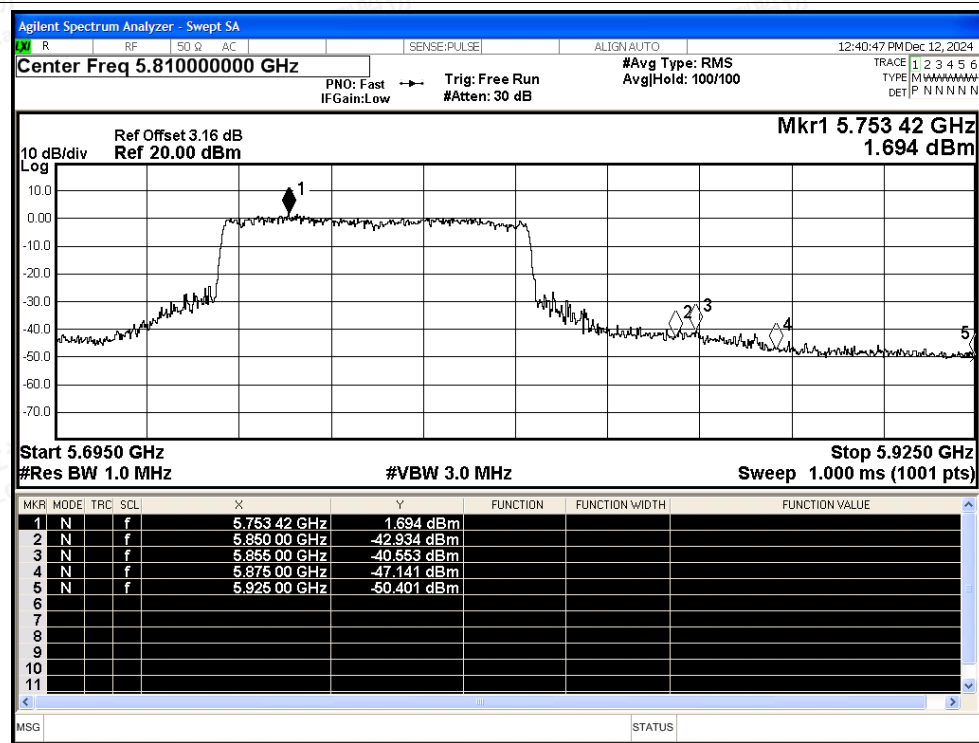

Restrict Band NVNT ac80 5775MHz Ant1 Average

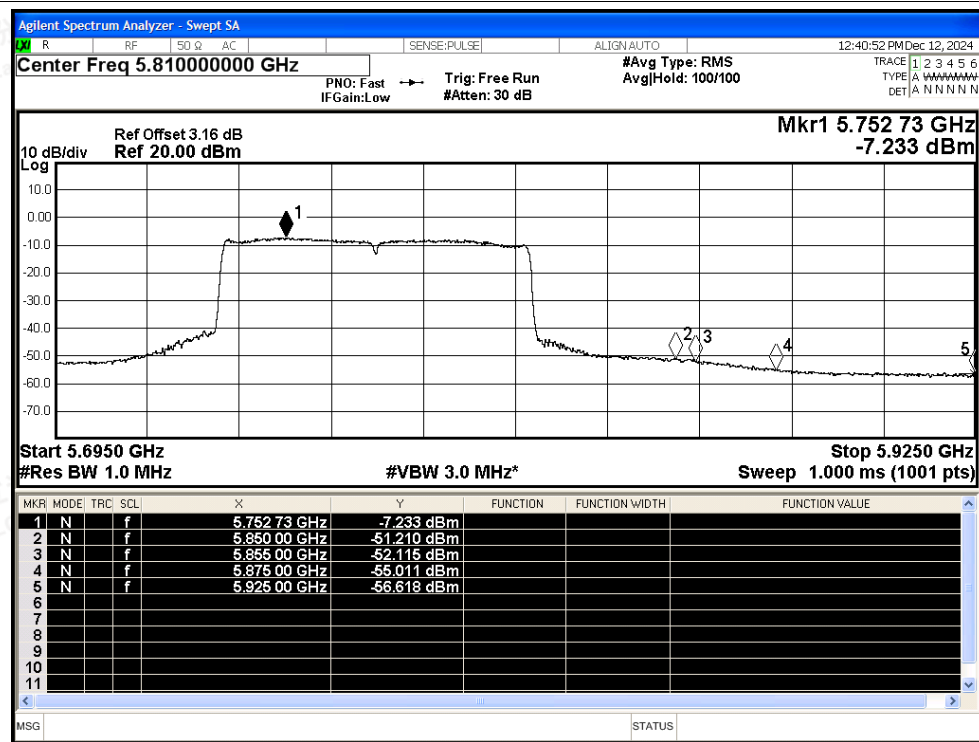

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant1 Peak

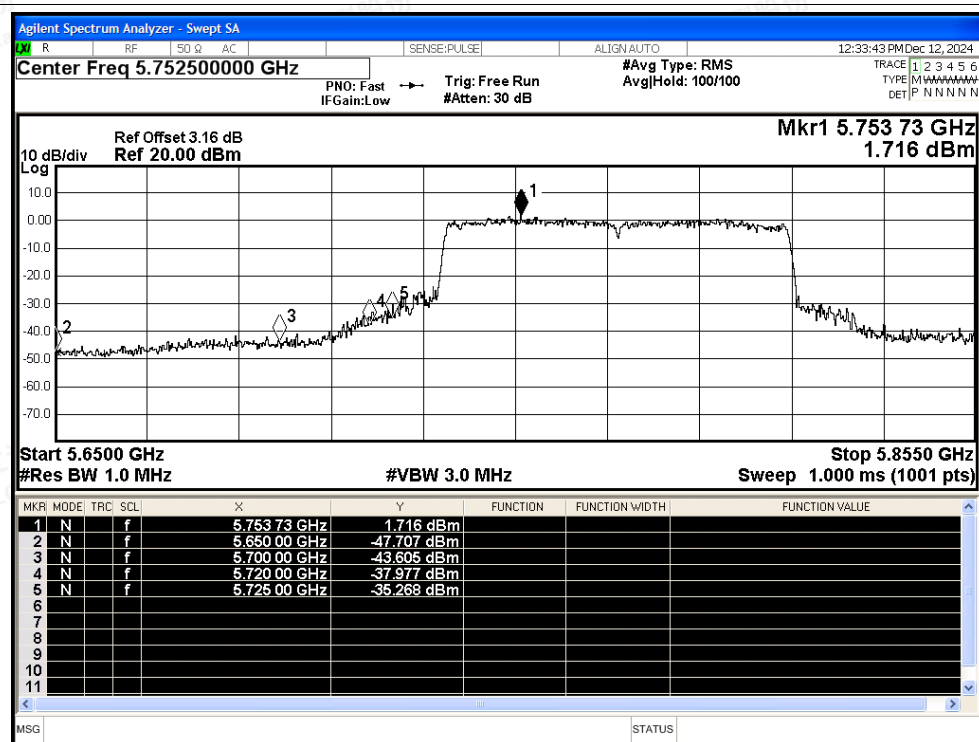

Restrict Band NVNT ac80 5775MHz Ant1 Average

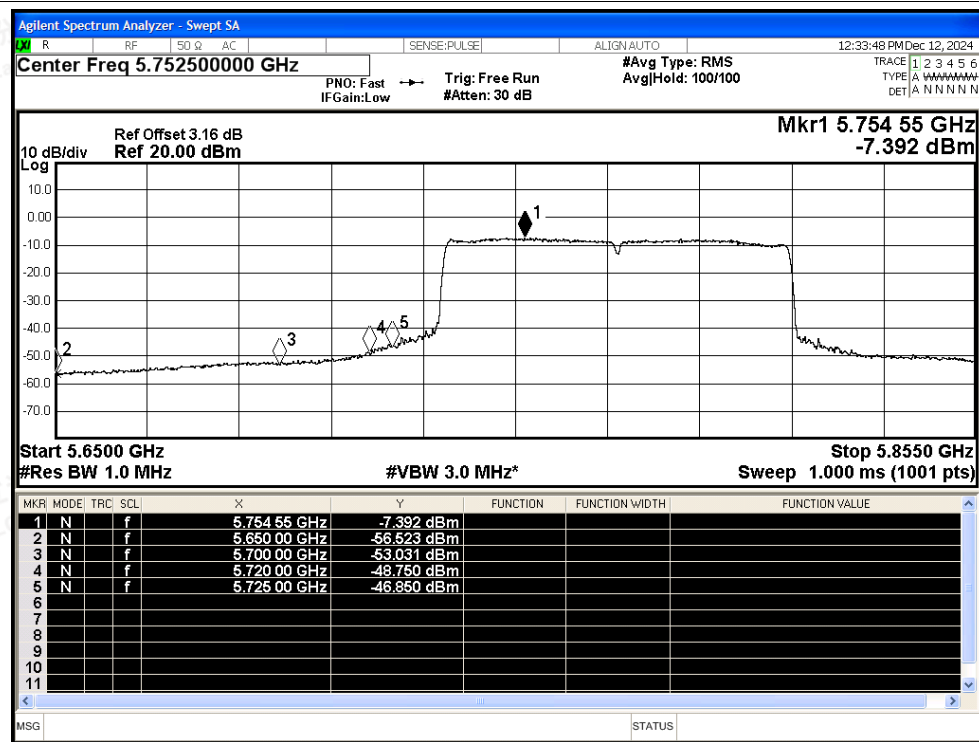

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant1 Peak

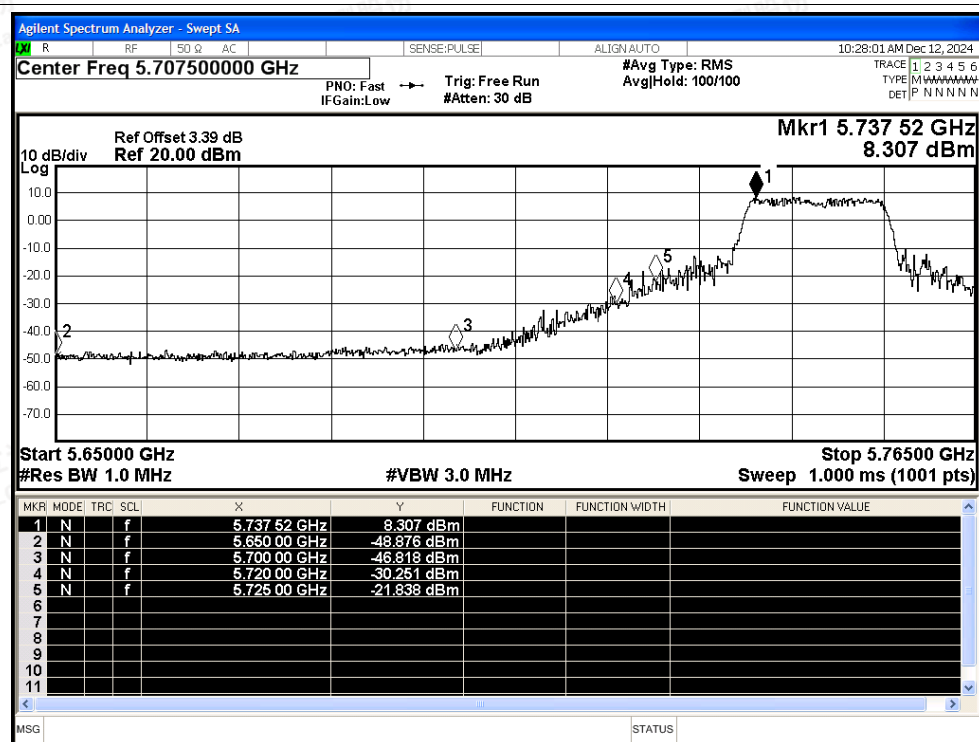

Restrict Band NVNT ax20 5745MHz Ant1 Average

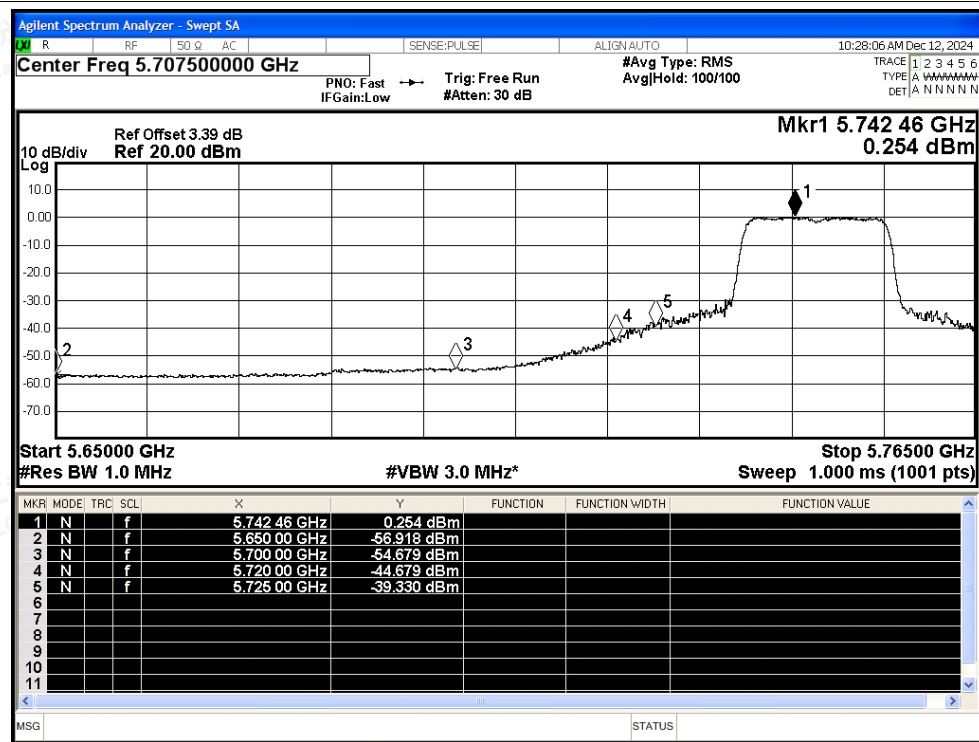

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant1 Peak

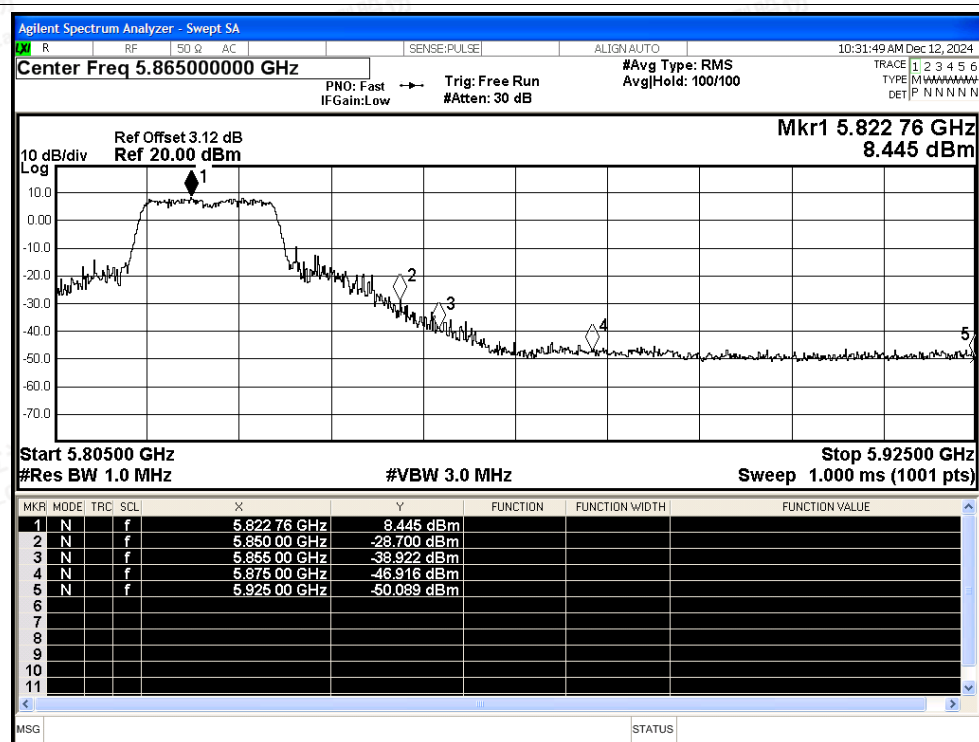

Restrict Band NVNT ax20 5825MHz Ant1 Average

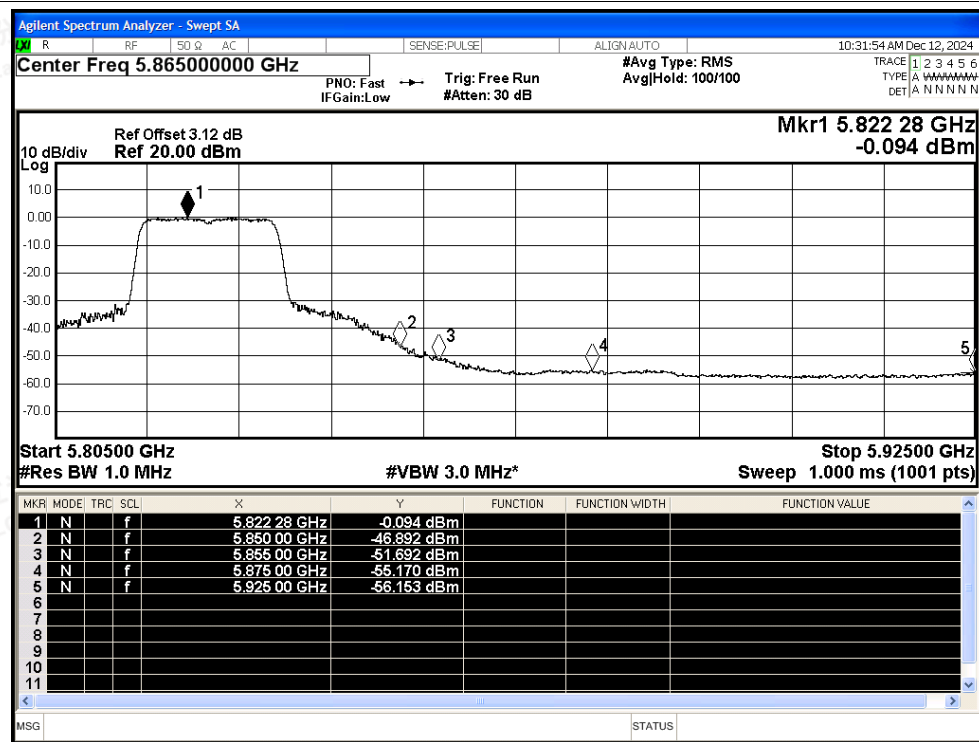

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant1 Peak

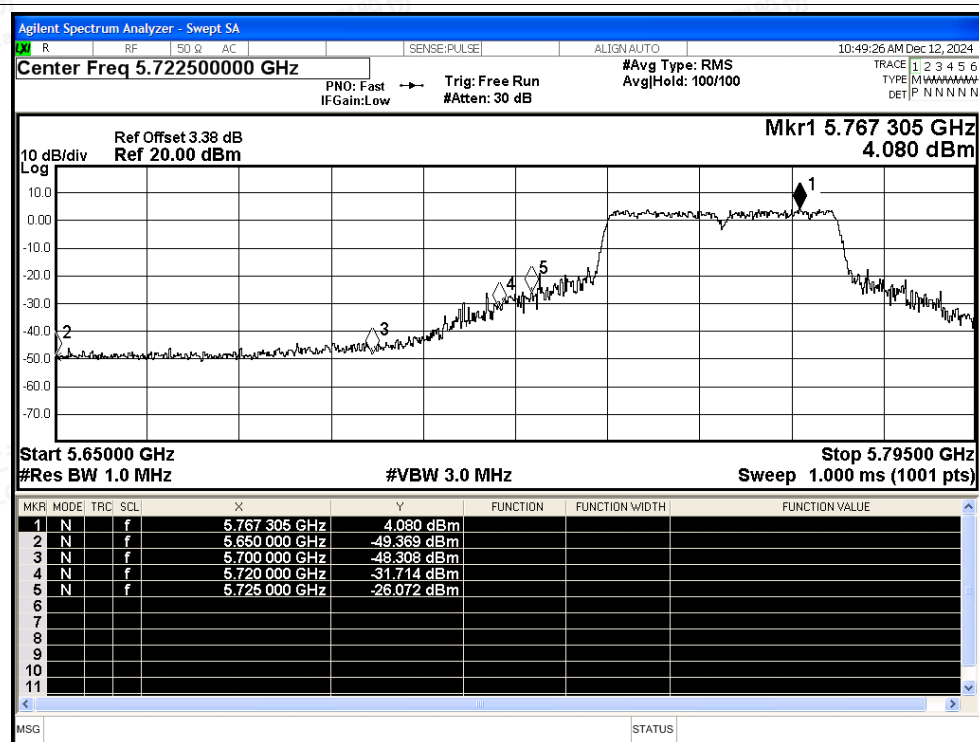

Restrict Band NVNT ax40 5755MHz Ant1 Average

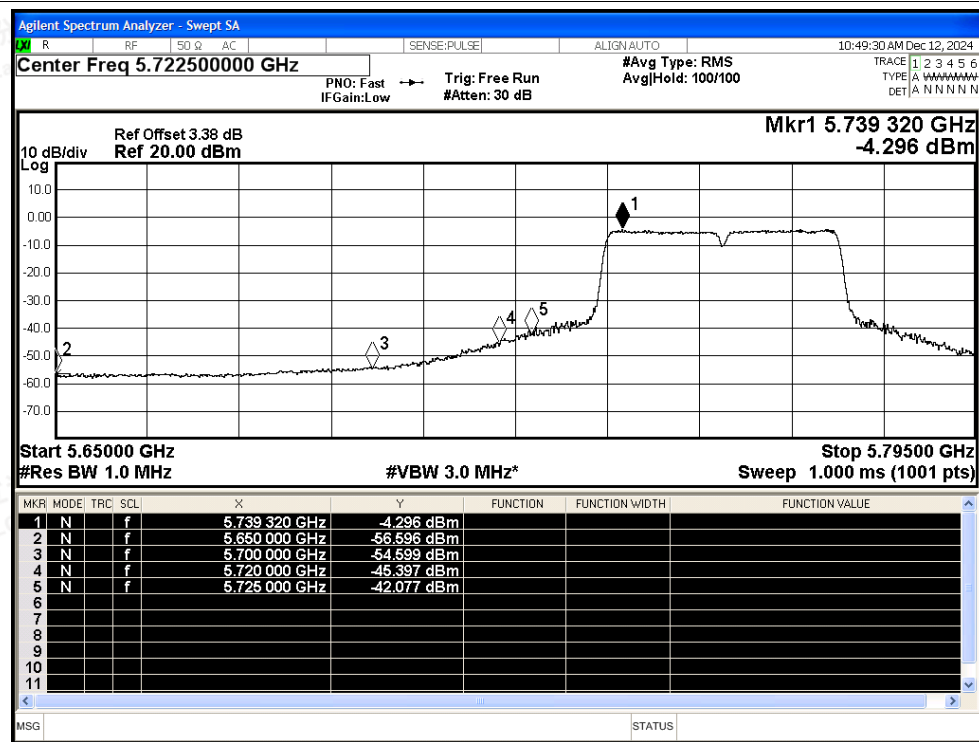

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant1 Peak

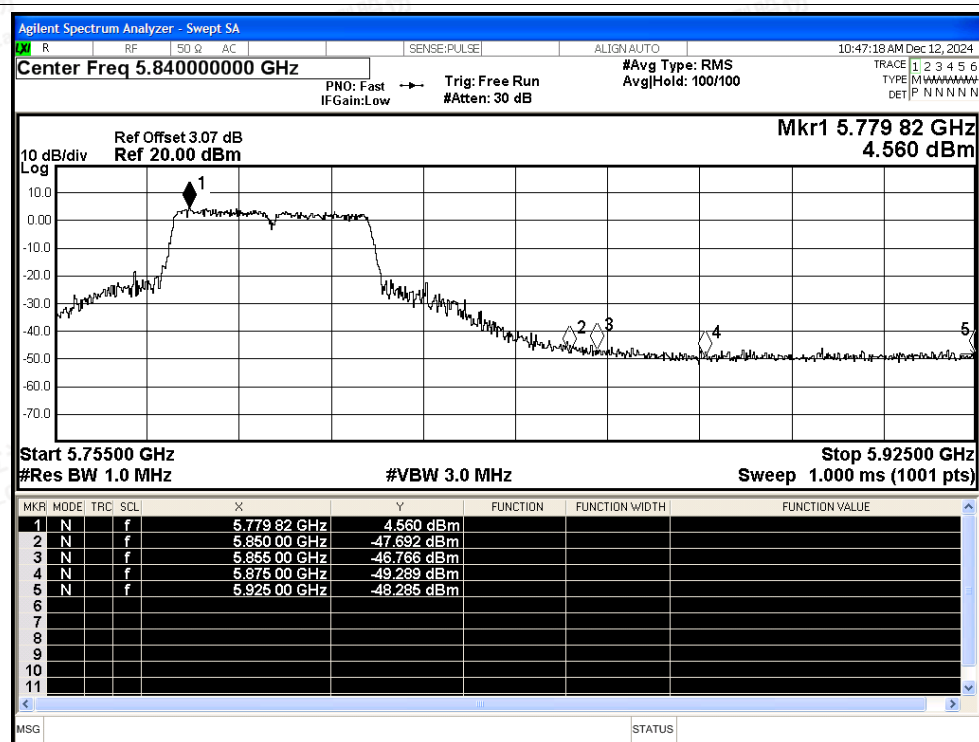

Restrict Band NVNT ax40 5795MHz Ant1 Average

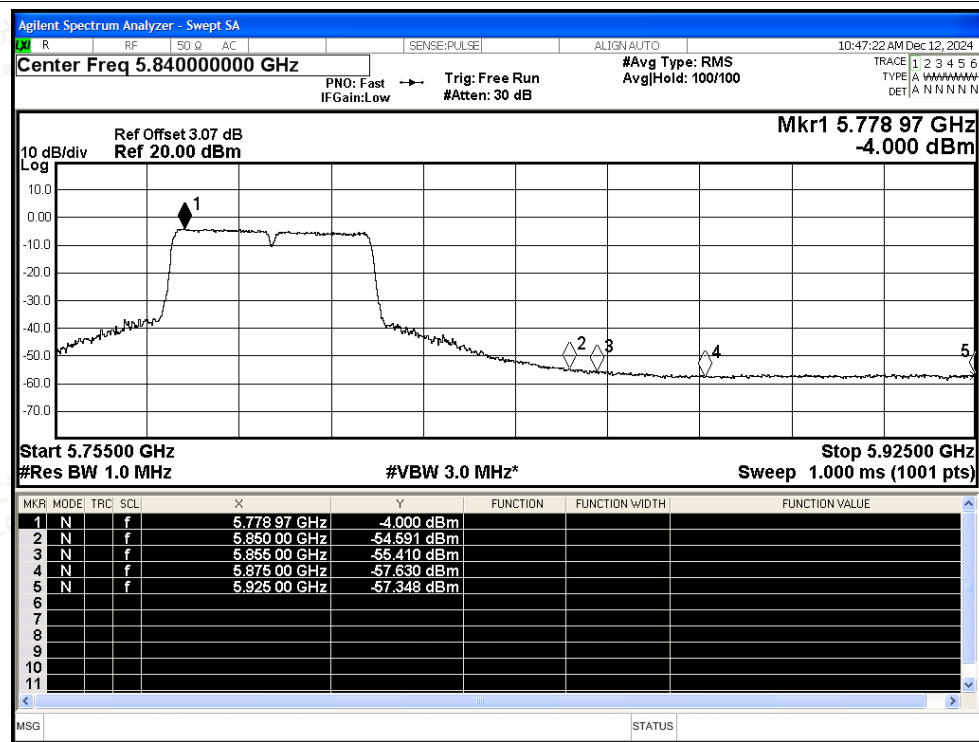

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant1 Peak

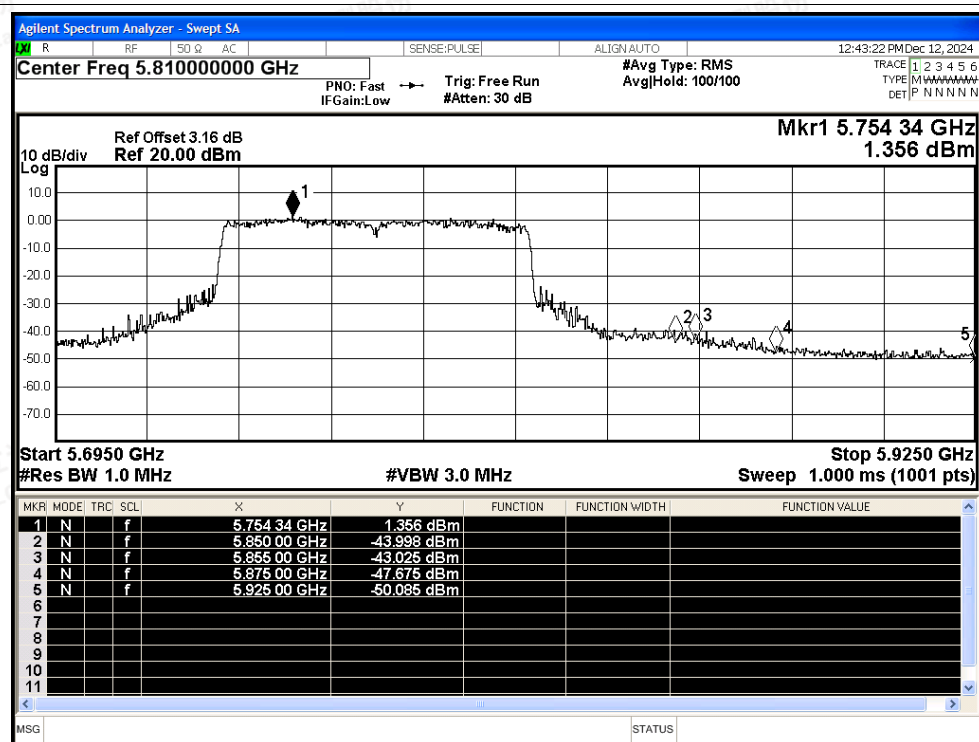

Restrict Band NVNT ax80 5775MHz Ant1 Average

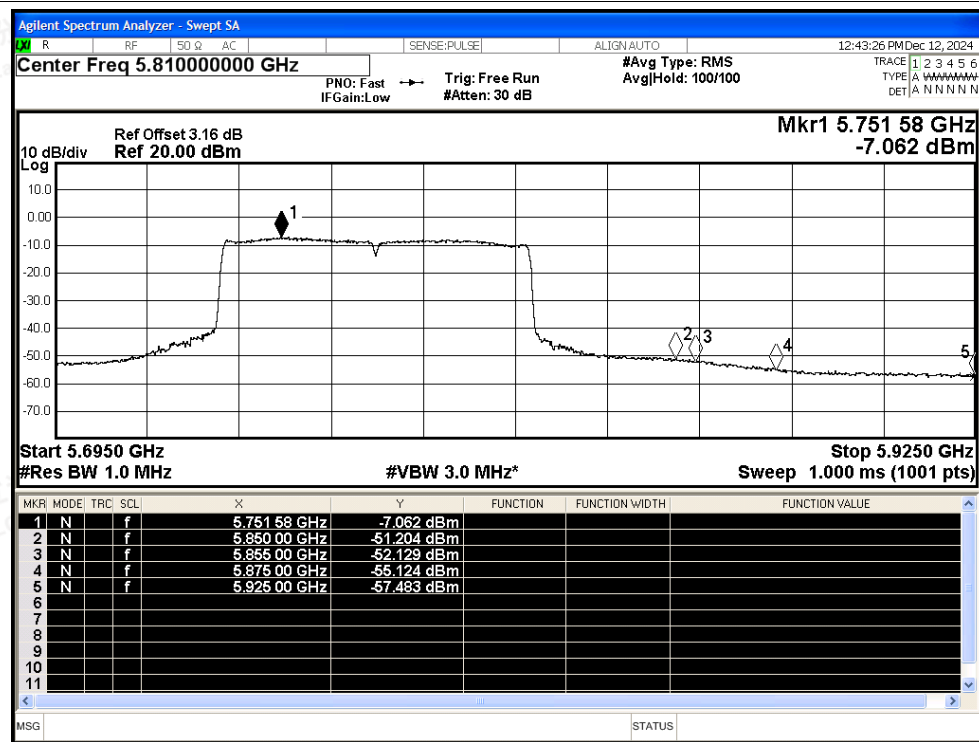

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant1 Peak

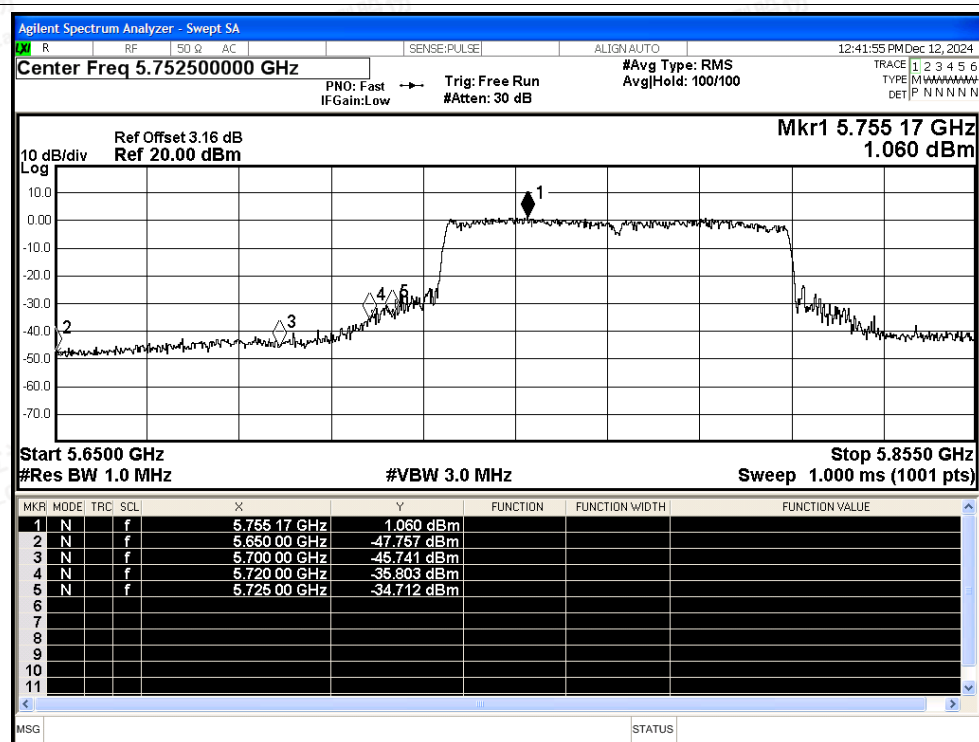

Restrict Band NVNT ax80 5775MHz Ant1 Average

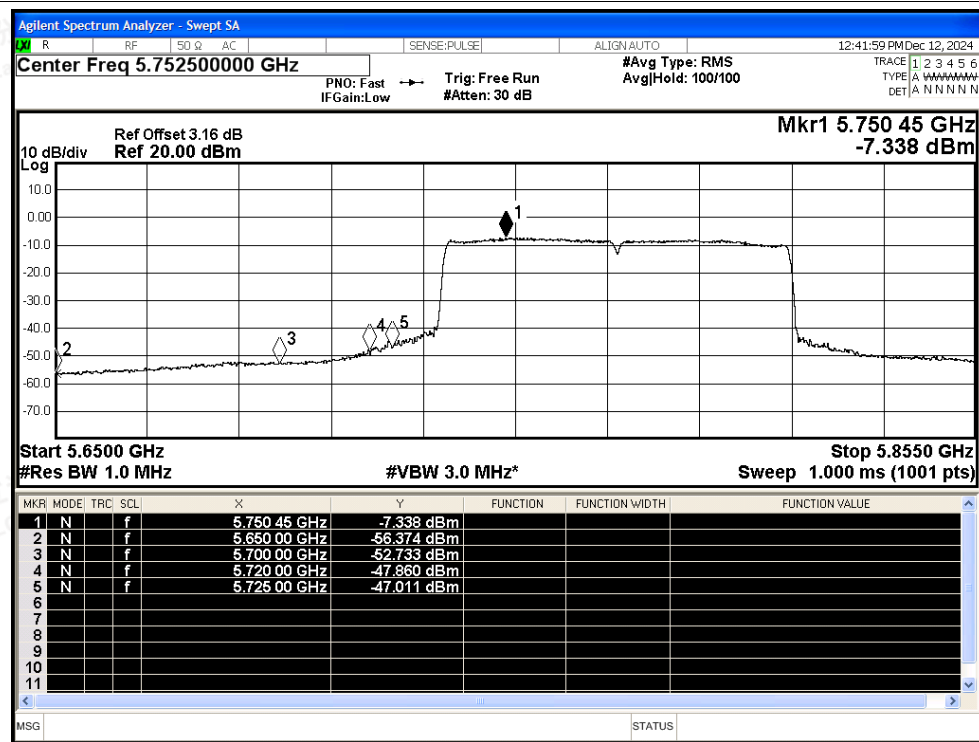

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant2	5650	-48.72	3	-	-45.72	Peak	-27	Pass
NVNT	a	5745	Ant2	5650	-57.43	3	0.24	-54.19	Average	-27	Pass
NVNT	a	5745	Ant2	5700	-47.76	3	-	-44.76	Peak	10	Pass
NVNT	a	5745	Ant2	5700	-54.96	3	0.24	-51.72	Average	10	Pass
NVNT	a	5745	Ant2	5720	-30.92	3	-	-27.92	Peak	15.6	Pass
NVNT	a	5745	Ant2	5720	-46.16	3	0.24	-42.92	Average	15.6	Pass
NVNT	a	5745	Ant2	5725	-23.88	3	-	-20.88	Peak	27	Pass
NVNT	a	5745	Ant2	5725	-43.68	3	0.24	-40.44	Average	27	Pass
NVNT	a	5825	Ant2	5850	-36.65	3	-	-33.65	Peak	27	Pass
NVNT	a	5825	Ant2	5850	-49.21	3	0.24	-45.97	Average	27	Pass
NVNT	a	5825	Ant2	5855	-41.08	3	-	-38.08	Peak	15.6	Pass
NVNT	a	5825	Ant2	5855	-54.06	3	0.24	-50.82	Average	15.6	Pass
NVNT	a	5825	Ant2	5875	-48.48	3	-	-45.48	Peak	10	Pass
NVNT	a	5825	Ant2	5875	-55.94	3	0.24	-52.70	Average	10	Pass
NVNT	a	5825	Ant2	5925	-48.37	3	-	-45.37	Peak	-27	Pass
NVNT	a	5825	Ant2	5925	-56.45	3	0.24	-53.21	Average	-27	Pass
NVNT	n20	5745	Ant2	5650	-49.11	3	-	-46.11	Peak	-27	Pass
NVNT	n20	5745	Ant2	5650	-57.62	3	0.12	-54.50	Average	-27	Pass
NVNT	n20	5745	Ant2	5700	-47.74	3	-	-44.74	Peak	10	Pass
NVNT	n20	5745	Ant2	5700	-55.64	3	0.12	-52.52	Average	10	Pass
NVNT	n20	5745	Ant2	5720	-31.08	3	-	-28.08	Peak	15.6	Pass
NVNT	n20	5745	Ant2	5720	-47.71	3	0.12	-44.59	Average	15.6	Pass
NVNT	n20	5745	Ant2	5725	-28.55	3	-	-25.55	Peak	27	Pass
NVNT	n20	5745	Ant2	5725	-40.99	3	0.12	-37.87	Average	27	Pass
NVNT	n20	5825	Ant2	5850	-29.48	3	-	-26.48	Peak	27	Pass
NVNT	n20	5825	Ant2	5850	-47.81	3	0.12	-44.69	Average	27	Pass
NVNT	n20	5825	Ant2	5855	-37.66	3	-	-34.66	Peak	15.6	Pass
NVNT	n20	5825	Ant2	5855	-51.57	3	0.12	-48.45	Average	15.6	Pass
NVNT	n20	5825	Ant2	5875	-48.9	3	-	-45.90	Peak	10	Pass
NVNT	n20	5825	Ant2	5875	-56.14	3	0.12	-53.02	Average	10	Pass
NVNT	n20	5825	Ant2	5925	-48.75	3	-	-45.75	Peak	-27	Pass
NVNT	n20	5825	Ant2	5925	-57.19	3	0.12	-54.07	Average	-27	Pass
NVNT	n40	5755	Ant2	5650	-48.79	3	-	-45.79	Peak	-27	Pass
NVNT	n40	5755	Ant2	5650	-57.84	3	0.24	-54.60	Average	-27	Pass
NVNT	n40	5755	Ant2	5700	-45.74	3	-	-42.74	Peak	10	Pass
NVNT	n40	5755	Ant2	5700	-54.64	3	0.24	-51.40	Average	10	Pass
NVNT	n40	5755	Ant2	5720	-32.57	3	-	-29.57	Peak	15.6	Pass
NVNT	n40	5755	Ant2	5720	-47.3	3	0.24	-44.06	Average	15.6	Pass
NVNT	n40	5755	Ant2	5725	-26.9	3	-	-23.90	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant2	5725	-43.48	3	0.24	-40.24	Average	27	Pass
NVNT	n40	5795	Ant2	5850	-47.64	3	-	-44.64	Peak	27	Pass
NVNT	n40	5795	Ant2	5850	-55.74	3	0.24	-52.50	Average	27	Pass
NVNT	n40	5795	Ant2	5855	-48.72	3	-	-45.72	Peak	15.6	Pass
NVNT	n40	5795	Ant2	5855	-56.15	3	0.24	-52.91	Average	15.6	Pass
NVNT	n40	5795	Ant2	5875	-50.51	3	-	-47.51	Peak	10	Pass
NVNT	n40	5795	Ant2	5875	-58.05	3	0.24	-54.81	Average	10	Pass
NVNT	n40	5795	Ant2	5925	-48.87	3	-	-45.87	Peak	-27	Pass
NVNT	n40	5795	Ant2	5925	-57.79	3	0.24	-54.55	Average	-27	Pass
NVNT	ac20	5745	Ant2	5650	-49.65	3	-	-46.65	Peak	-27	Pass
NVNT	ac20	5745	Ant2	5650	-57.51	3	0.12	-54.39	Average	-27	Pass
NVNT	ac20	5745	Ant2	5700	-46.65	3	-	-43.65	Peak	10	Pass
NVNT	ac20	5745	Ant2	5700	-55.34	3	0.12	-52.22	Average	10	Pass
NVNT	ac20	5745	Ant2	5720	-29.23	3	-	-26.23	Peak	15.6	Pass
NVNT	ac20	5745	Ant2	5720	-47.4	3	0.12	-44.28	Average	15.6	Pass
NVNT	ac20	5745	Ant2	5725	-22.65	3	-	-19.65	Peak	27	Pass
NVNT	ac20	5745	Ant2	5725	-40.56	3	0.12	-37.44	Average	27	Pass
NVNT	ac20	5825	Ant2	5850	-33.17	3	-	-30.17	Peak	27	Pass
NVNT	ac20	5825	Ant2	5850	-48.52	3	0.12	-45.40	Average	27	Pass
NVNT	ac20	5825	Ant2	5855	-40.91	3	-	-37.91	Peak	15.6	Pass
NVNT	ac20	5825	Ant2	5855	-51.67	3	0.12	-48.55	Average	15.6	Pass
NVNT	ac20	5825	Ant2	5875	-47.52	3	-	-44.52	Peak	10	Pass
NVNT	ac20	5825	Ant2	5875	-56.24	3	0.12	-53.12	Average	10	Pass
NVNT	ac20	5825	Ant2	5925	-48.9	3	-	-45.90	Peak	-27	Pass
NVNT	ac20	5825	Ant2	5925	-56.83	3	0.12	-53.71	Average	-27	Pass
NVNT	ac40	5755	Ant2	5650	-49.39	3	-	-46.39	Peak	-27	Pass
NVNT	ac40	5755	Ant2	5650	-57.57	3	0.24	-54.33	Average	-27	Pass
NVNT	ac40	5755	Ant2	5700	-45.95	3	-	-42.95	Peak	10	Pass
NVNT	ac40	5755	Ant2	5700	-54.91	3	0.24	-51.67	Average	10	Pass
NVNT	ac40	5755	Ant2	5720	-32.29	3	-	-29.29	Peak	15.6	Pass
NVNT	ac40	5755	Ant2	5720	-46.23	3	0.24	-42.99	Average	15.6	Pass
NVNT	ac40	5755	Ant2	5725	-31.24	3	-	-28.24	Peak	27	Pass
NVNT	ac40	5755	Ant2	5725	-42.49	3	0.24	-39.25	Average	27	Pass
NVNT	ac40	5795	Ant2	5850	-47.66	3	-	-44.66	Peak	27	Pass
NVNT	ac40	5795	Ant2	5850	-56.03	3	0.24	-52.79	Average	27	Pass
NVNT	ac40	5795	Ant2	5855	-48.51	3	-	-45.51	Peak	15.6	Pass
NVNT	ac40	5795	Ant2	5855	-56.32	3	0.24	-53.08	Average	15.6	Pass
NVNT	ac40	5795	Ant2	5875	-48.76	3	-	-45.76	Peak	10	Pass
NVNT	ac40	5795	Ant2	5875	-57.64	3	0.24	-54.40	Average	10	Pass
NVNT	ac40	5795	Ant2	5925	-50.07	3	-	-47.07	Peak	-27	Pass
NVNT	ac40	5795	Ant2	5925	-57.29	3	0.24	-54.05	Average	-27	Pass
NVNT	ac80	5775	Ant2	5850	-43.17	3	-	-40.17	Peak	27	Pass
NVNT	ac80	5775	Ant2	5850	-53.9	3	0.47	-50.43	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	Ant2	5855	-45.77	3	-	-42.77	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5855	-54.13	3	0.47	-50.66	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5875	-47.96	3	-	-44.96	Peak	10	Pass
NVNT	ac80	5775	Ant2	5875	-56.25	3	0.47	-52.78	Average	10	Pass
NVNT	ac80	5775	Ant2	5925	-49.48	3	-	-46.48	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5925	-57.24	3	0.47	-53.77	Average	-27	Pass
NVNT	ac80	5775	Ant2	5650	-48.68	3	-	-45.68	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5650	-57.51	3	0.47	-54.04	Average	-27	Pass
NVNT	ac80	5775	Ant2	5700	-43.34	3	-	-40.34	Peak	10	Pass
NVNT	ac80	5775	Ant2	5700	-52.65	3	0.47	-49.18	Average	10	Pass
NVNT	ac80	5775	Ant2	5720	-40.02	3	-	-37.02	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5720	-50.05	3	0.47	-46.58	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5725	-37.07	3	-	-34.07	Peak	27	Pass
NVNT	ac80	5775	Ant2	5725	-46.59	3	0.47	-43.12	Average	27	Pass
NVNT	ax20	5745	Ant2	5650	-49.16	3	-	-46.16	Peak	-27	Pass
NVNT	ax20	5745	Ant2	5650	-57.48	3	0.12	-54.36	Average	-27	Pass
NVNT	ax20	5745	Ant2	5700	-48.59	3	-	-45.59	Peak	10	Pass
NVNT	ax20	5745	Ant2	5700	-55.52	3	0.12	-52.40	Average	10	Pass
NVNT	ax20	5745	Ant2	5720	-33.52	3	-	-30.52	Peak	15.6	Pass
NVNT	ax20	5745	Ant2	5720	-48.6	3	0.12	-45.48	Average	15.6	Pass
NVNT	ax20	5745	Ant2	5725	-23.28	3	-	-20.28	Peak	27	Pass
NVNT	ax20	5745	Ant2	5725	-42.46	3	0.12	-39.34	Average	27	Pass
NVNT	ax20	5825	Ant2	5850	-35.19	3	-	-32.19	Peak	27	Pass
NVNT	ax20	5825	Ant2	5850	-47.41	3	0.12	-44.29	Average	27	Pass
NVNT	ax20	5825	Ant2	5855	-41.13	3	-	-38.13	Peak	15.6	Pass
NVNT	ax20	5825	Ant2	5855	-52.47	3	0.12	-49.35	Average	15.6	Pass
NVNT	ax20	5825	Ant2	5875	-46.98	3	-	-43.98	Peak	10	Pass
NVNT	ax20	5825	Ant2	5875	-56.42	3	0.12	-53.30	Average	10	Pass
NVNT	ax20	5825	Ant2	5925	-49.66	3	-	-46.66	Peak	-27	Pass
NVNT	ax20	5825	Ant2	5925	-56.93	3	0.12	-53.81	Average	-27	Pass
NVNT	ax40	5755	Ant2	5650	-47.75	3	-	-44.75	Peak	-27	Pass
NVNT	ax40	5755	Ant2	5650	-57.53	3	0.24	-54.29	Average	-27	Pass
NVNT	ax40	5755	Ant2	5700	-47.7	3	-	-44.70	Peak	10	Pass
NVNT	ax40	5755	Ant2	5700	-55.09	3	0.24	-51.85	Average	10	Pass
NVNT	ax40	5755	Ant2	5720	-31.17	3	-	-28.17	Peak	15.6	Pass
NVNT	ax40	5755	Ant2	5720	-45.64	3	0.24	-42.40	Average	15.6	Pass
NVNT	ax40	5755	Ant2	5725	-30.19	3	-	-27.19	Peak	27	Pass
NVNT	ax40	5755	Ant2	5725	-42.69	3	0.24	-39.45	Average	27	Pass
NVNT	ax40	5795	Ant2	5850	-49.31	3	-	-46.31	Peak	27	Pass
NVNT	ax40	5795	Ant2	5850	-56.38	3	0.24	-53.14	Average	27	Pass
NVNT	ax40	5795	Ant2	5855	-47.75	3	-	-44.75	Peak	15.6	Pass
NVNT	ax40	5795	Ant2	5855	-56.84	3	0.24	-53.60	Average	15.6	Pass
NVNT	ax40	5795	Ant2	5875	-49.99	3	-	-46.99	Peak	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5795	Ant2	5875	-57.57	3	0.24	-54.33	Average	10	Pass
NVNT	ax40	5795	Ant2	5925	-50.1	3	-	-47.10	Peak	-27	Pass
NVNT	ax40	5795	Ant2	5925	-58.12	3	0.24	-54.88	Average	-27	Pass
NVNT	ax80	5775	Ant2	5850	-42.16	3	-	-39.16	Peak	27	Pass
NVNT	ax80	5775	Ant2	5850	-54.14	3	0.47	-50.67	Average	27	Pass
NVNT	ax80	5775	Ant2	5855	-46.1	3	-	-43.10	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5855	-54.22	3	0.47	-50.75	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5875	-47.57	3	-	-44.57	Peak	10	Pass
NVNT	ax80	5775	Ant2	5875	-55.96	3	0.47	-52.49	Average	10	Pass
NVNT	ax80	5775	Ant2	5925	-47.76	3	-	-44.76	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5925	-57.14	3	0.47	-53.67	Average	-27	Pass
NVNT	ax80	5775	Ant2	5650	-48.6	3	-	-45.60	Peak	-27	Pass
NVNT	ax80	5775	Ant2	5650	-56.77	3	0.47	-53.30	Average	-27	Pass
NVNT	ax80	5775	Ant2	5700	-43.14	3	-	-40.14	Peak	10	Pass
NVNT	ax80	5775	Ant2	5700	-52.43	3	0.47	-48.96	Average	10	Pass
NVNT	ax80	5775	Ant2	5720	-38.38	3	-	-35.38	Peak	15.6	Pass
NVNT	ax80	5775	Ant2	5720	-50.14	3	0.47	-46.67	Average	15.6	Pass
NVNT	ax80	5775	Ant2	5725	-37.52	3	-	-34.52	Peak	27	Pass
NVNT	ax80	5775	Ant2	5725	-48.94	3	0.47	-45.47	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5745MHz Ant2 Peak

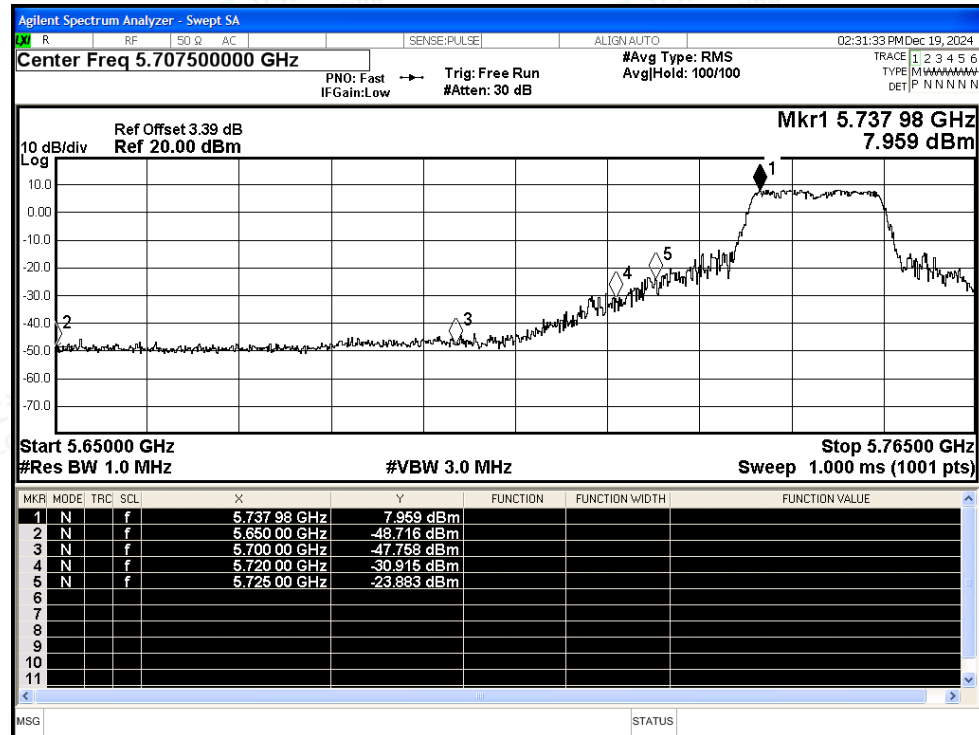

Restrict Band NVNT a 5745MHz Ant2 Average

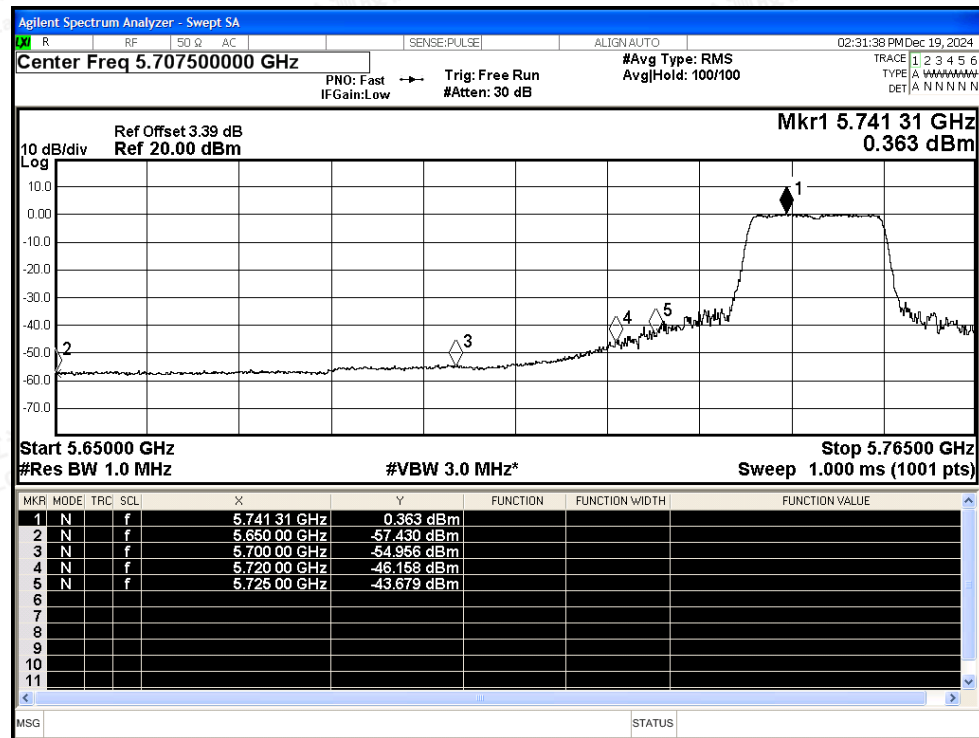

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant2 Peak

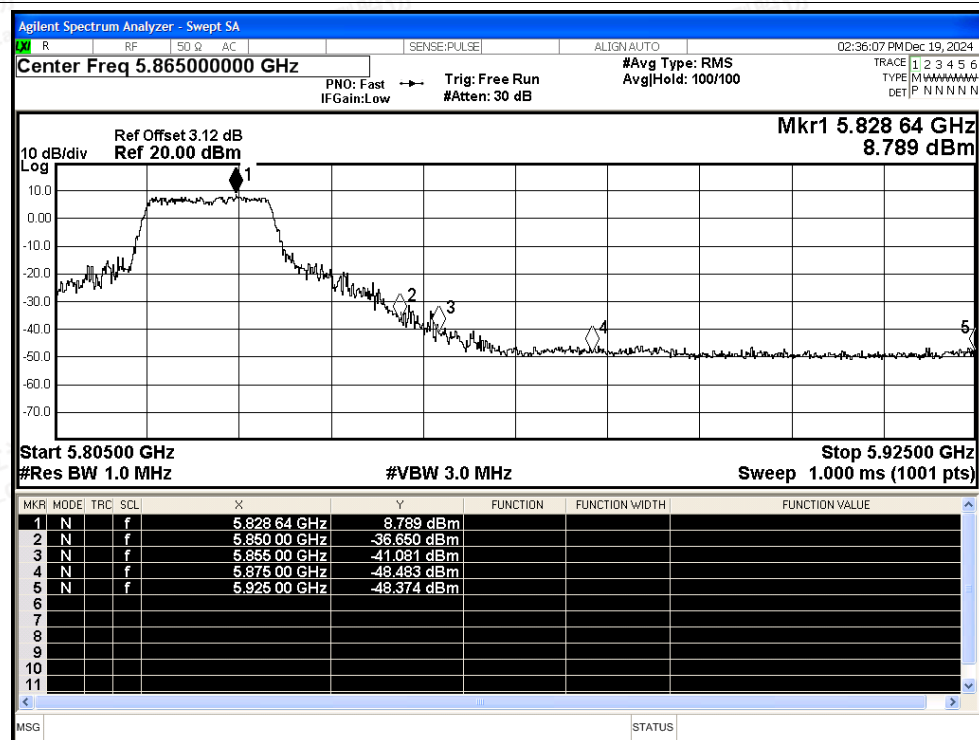

Restrict Band NVNT a 5825MHz Ant2 Average

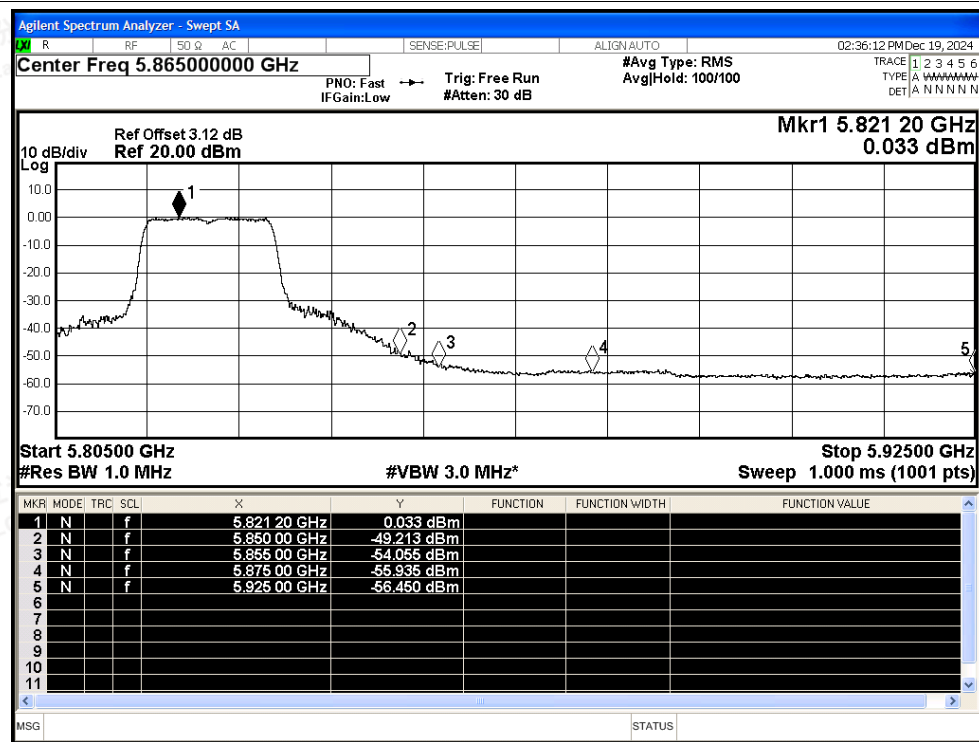

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5745MHz Ant2 Peak

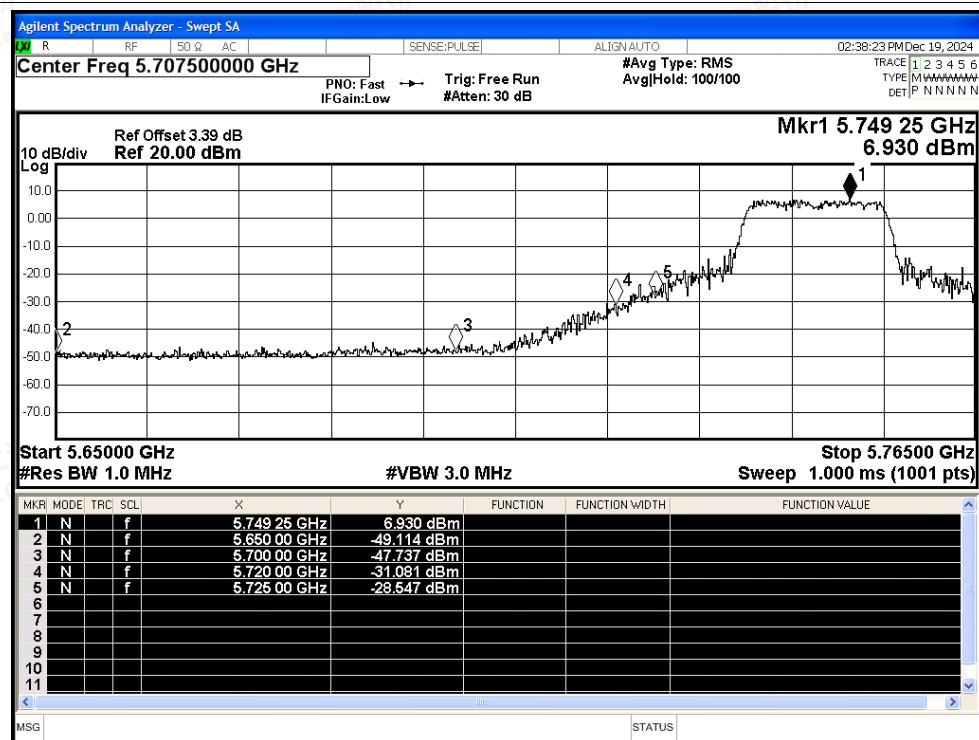

Restrict Band NVNT n20 5745MHz Ant2 Average

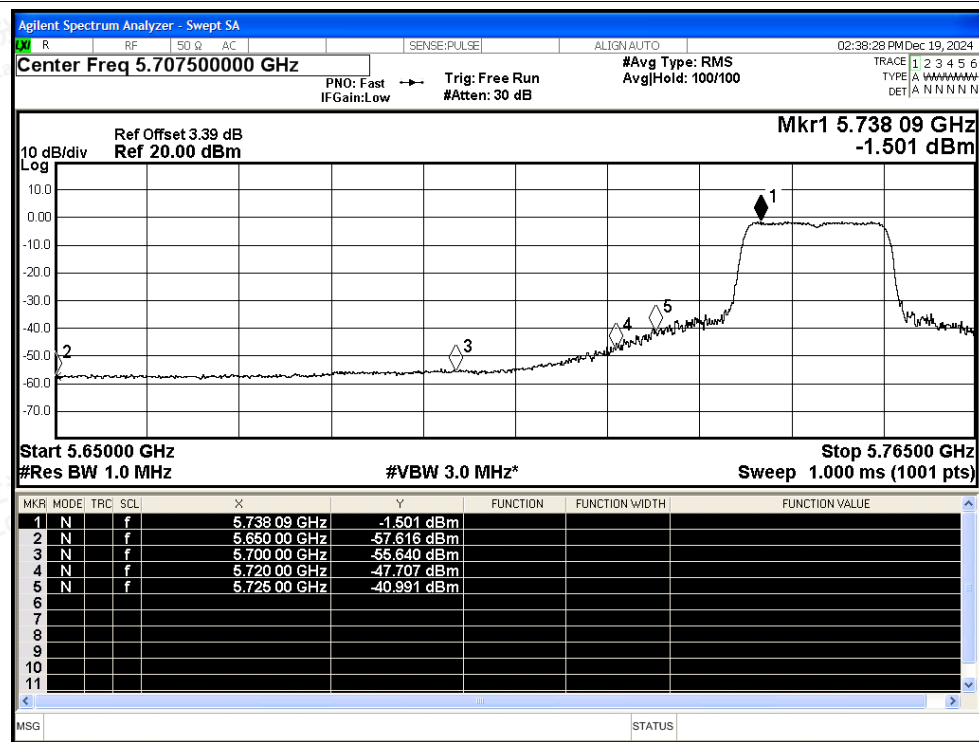

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant2 Peak

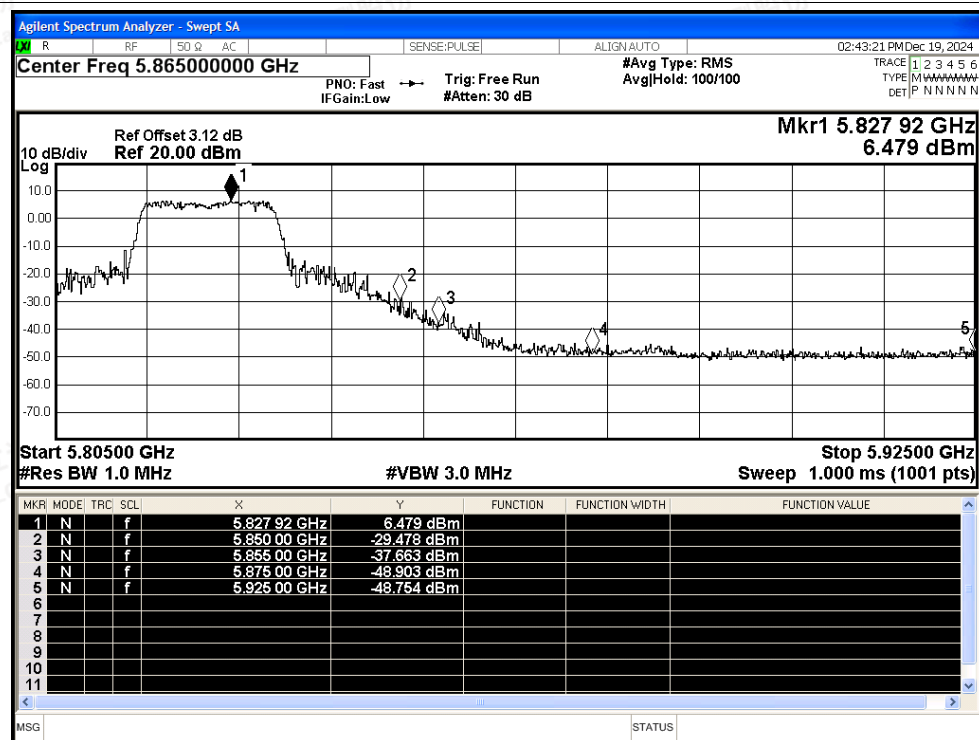

Restrict Band NVNT n20 5825MHz Ant2 Average

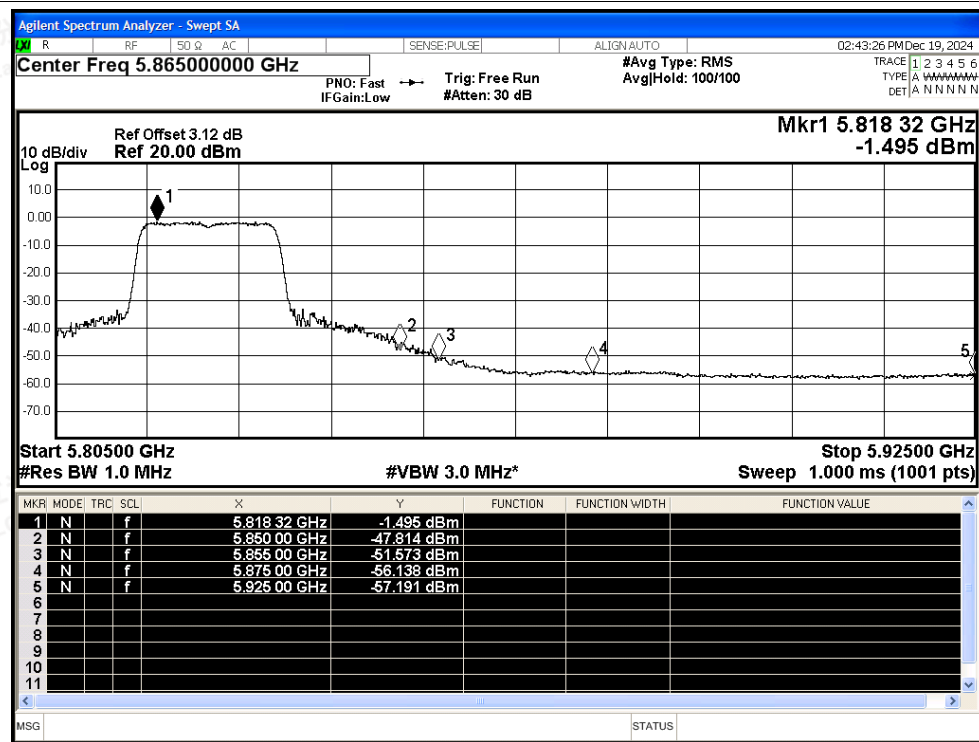

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant2 Peak

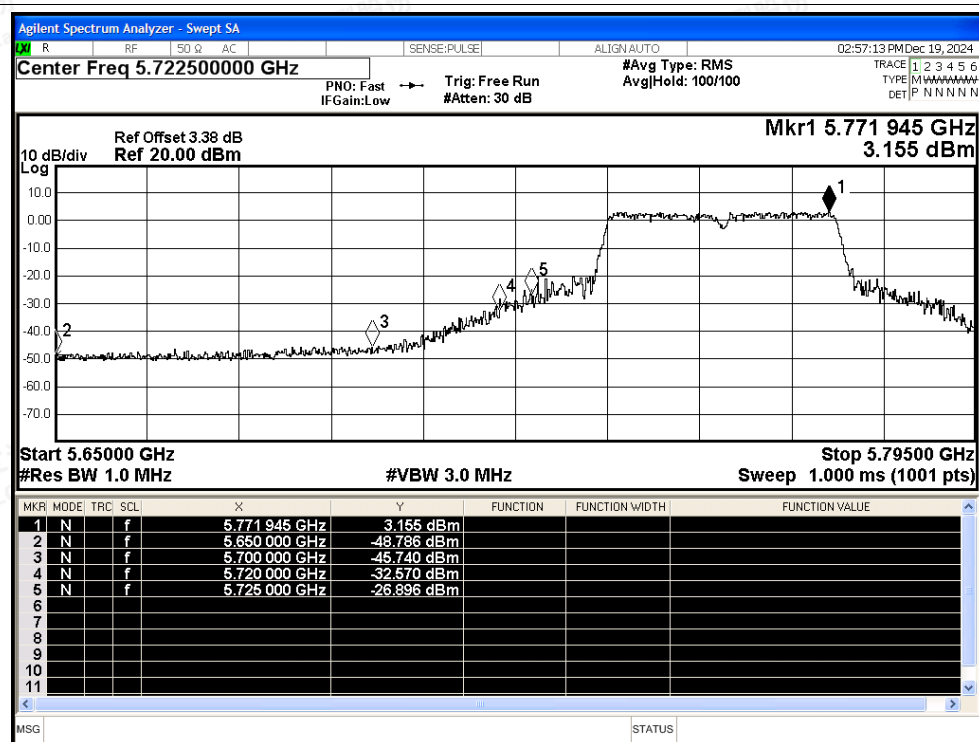

Restrict Band NVNT n40 5755MHz Ant2 Average

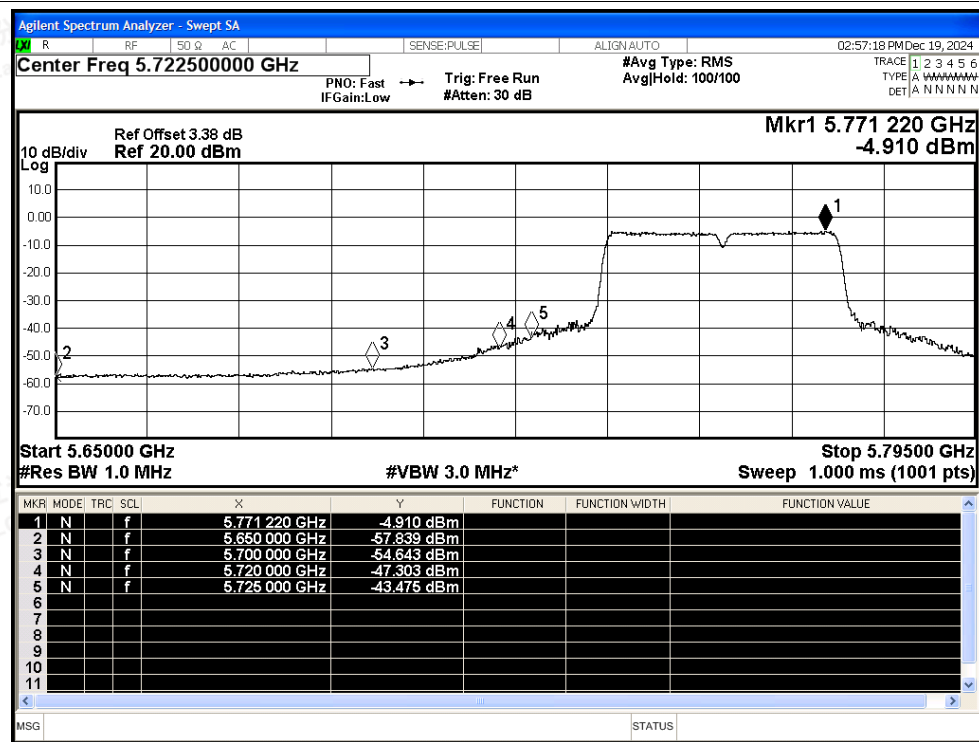

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant2 Peak

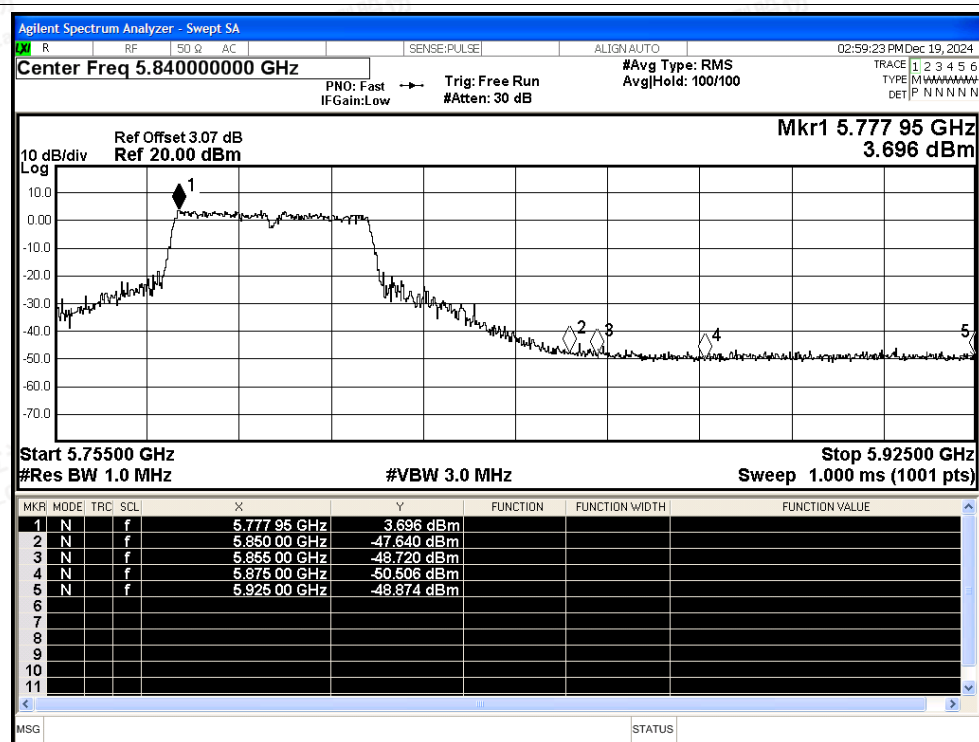

Restrict Band NVNT n40 5795MHz Ant2 Average

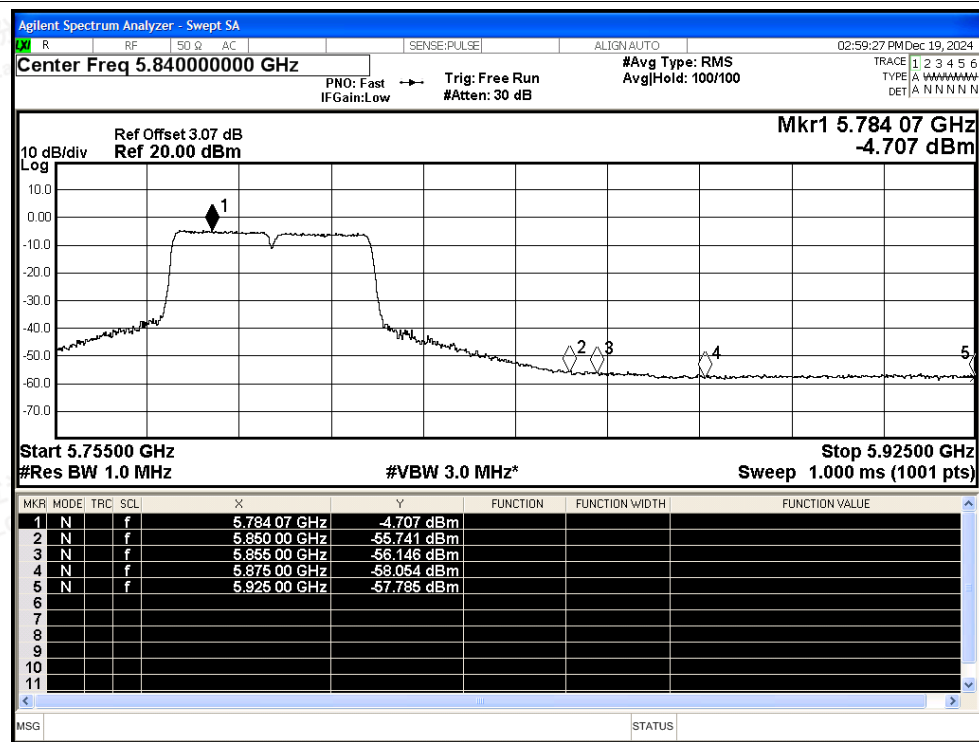

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant2 Peak

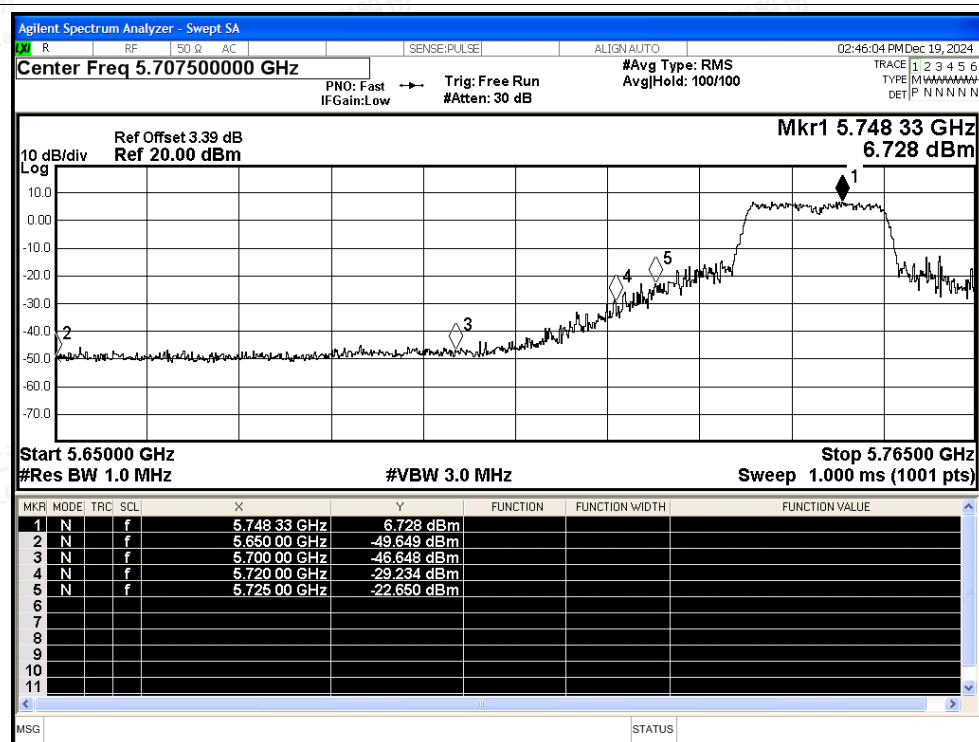

Restrict Band NVNT ac20 5745MHz Ant2 Average

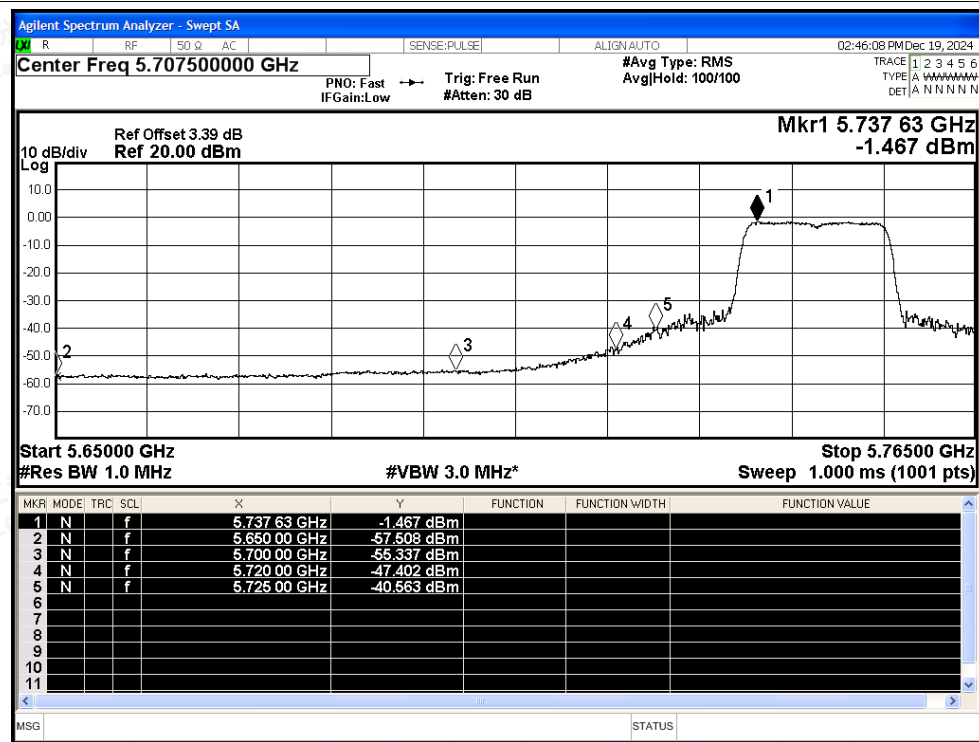

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant2 Peak

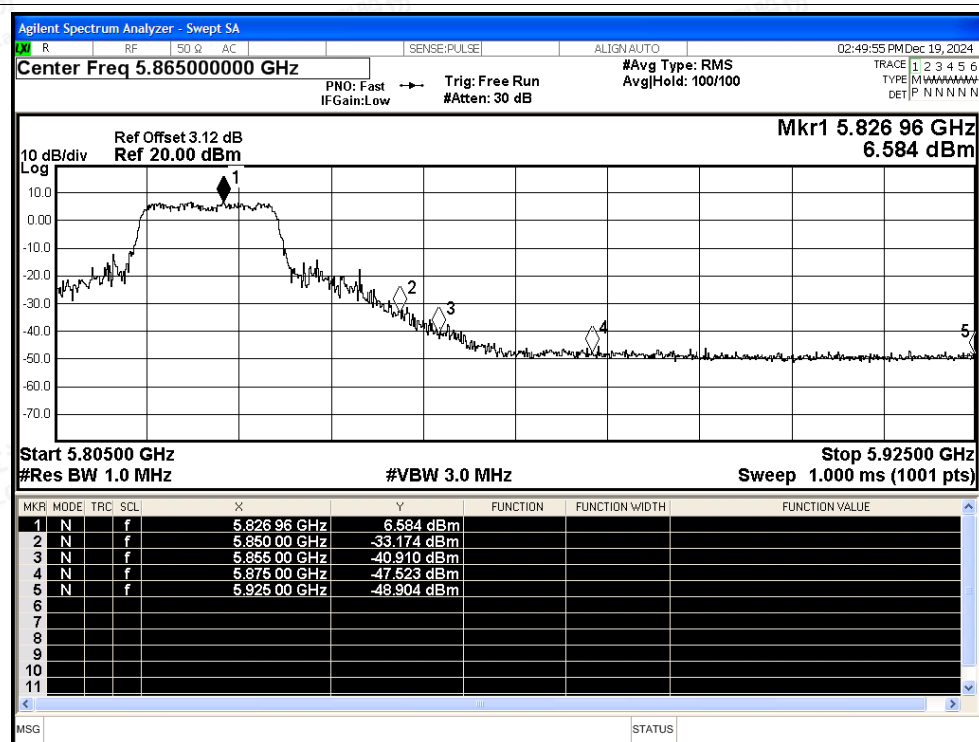

Restrict Band NVNT ac20 5825MHz Ant2 Average

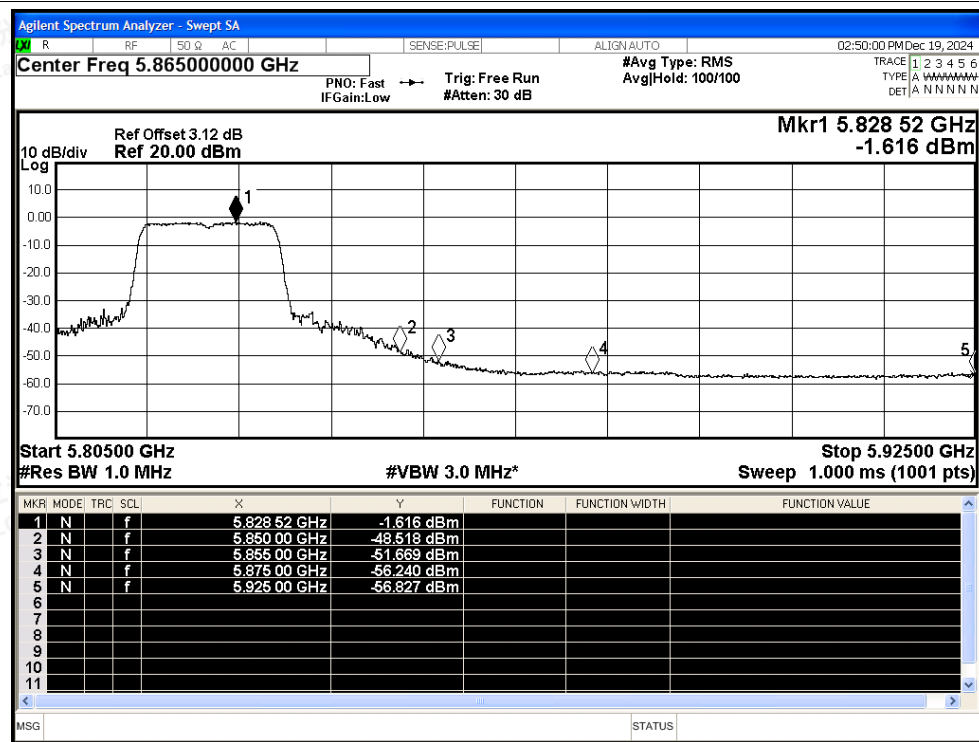

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant2 Peak

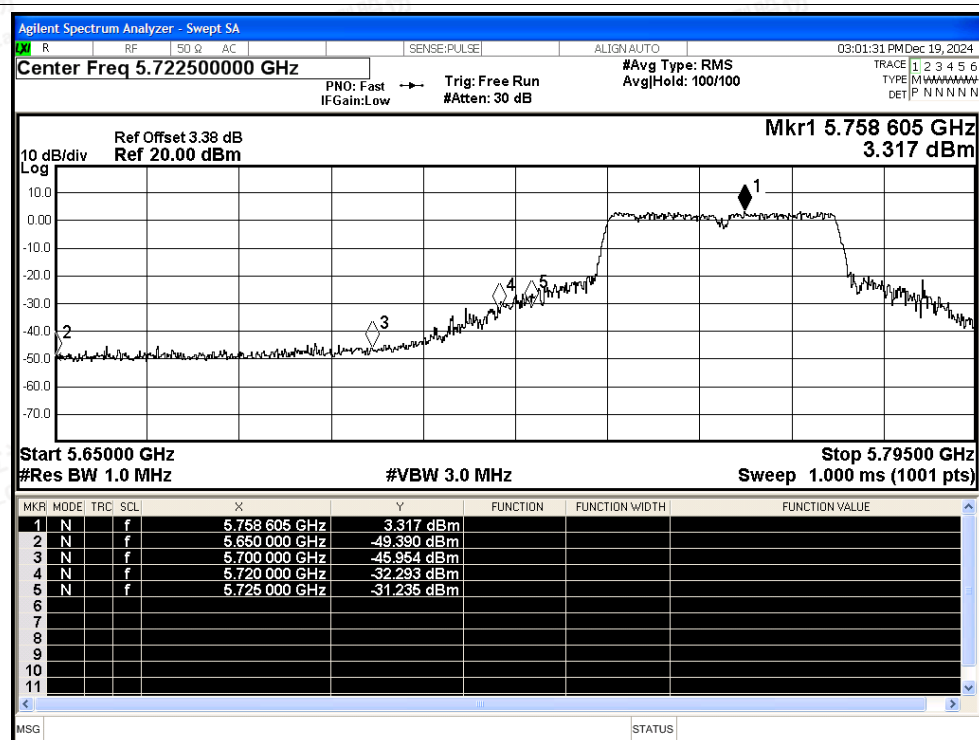

Restrict Band NVNT ac40 5755MHz Ant2 Average

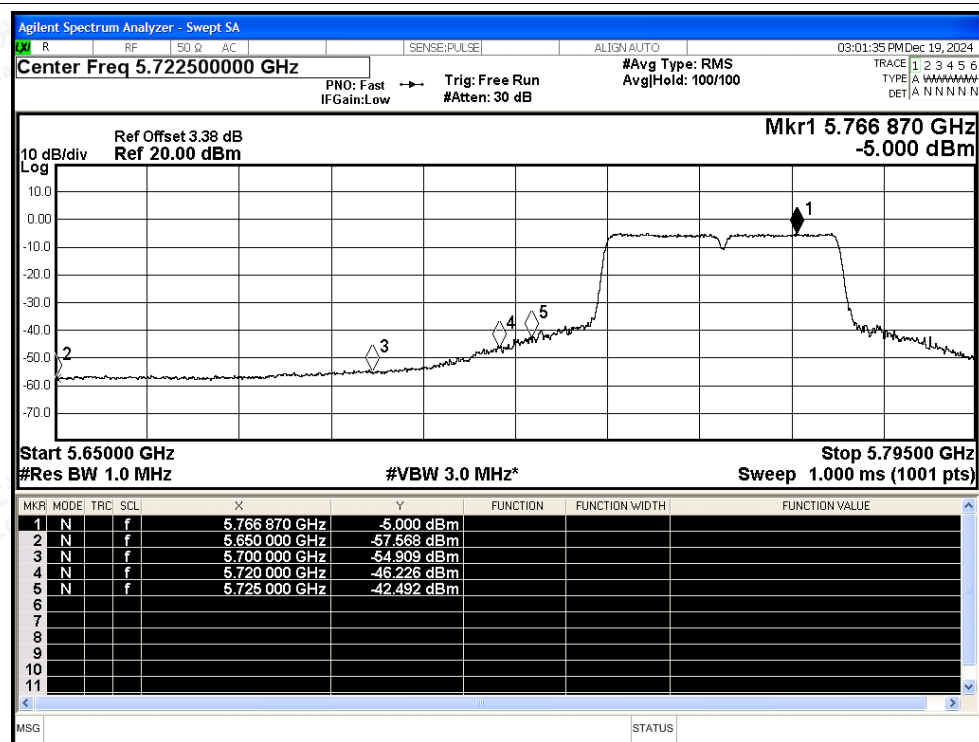

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant2 Peak

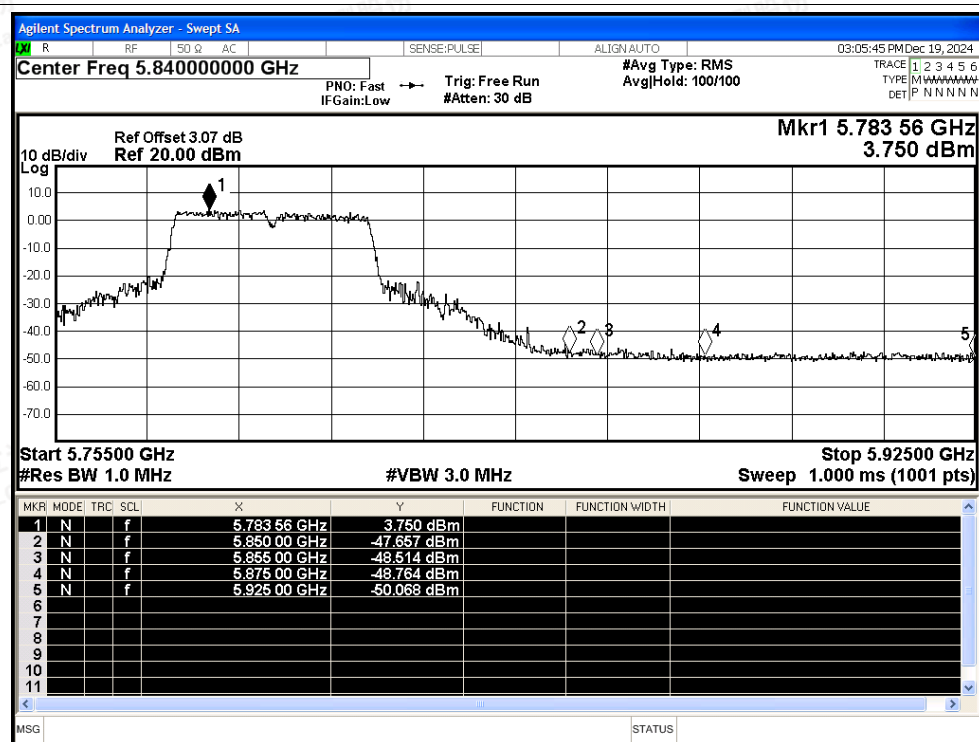

Restrict Band NVNT ac40 5795MHz Ant2 Average

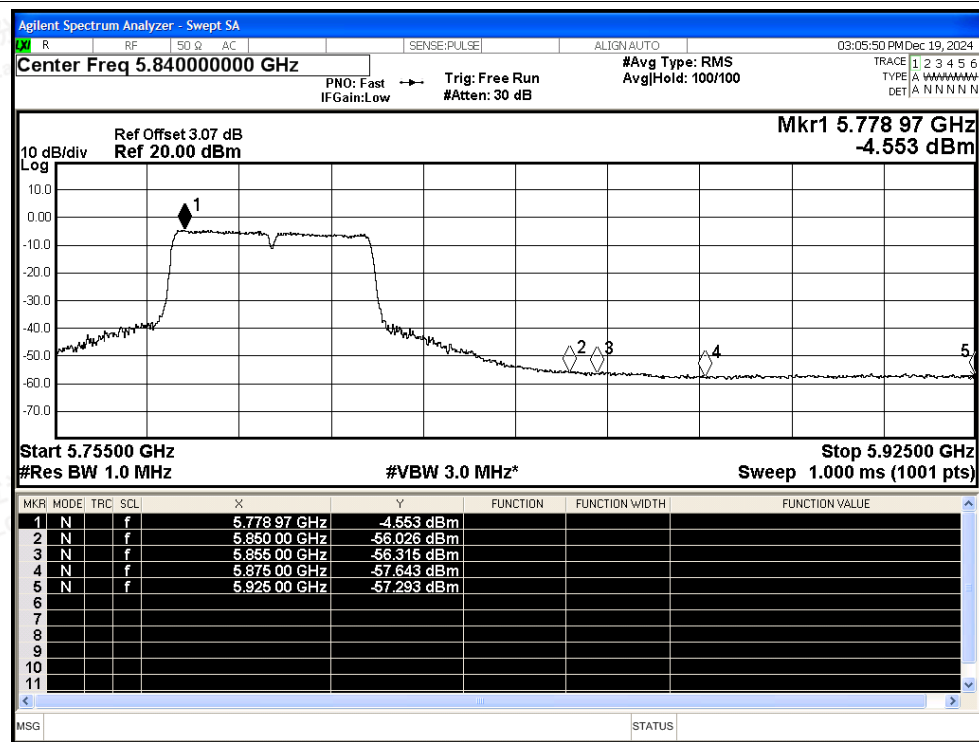

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant2 Peak

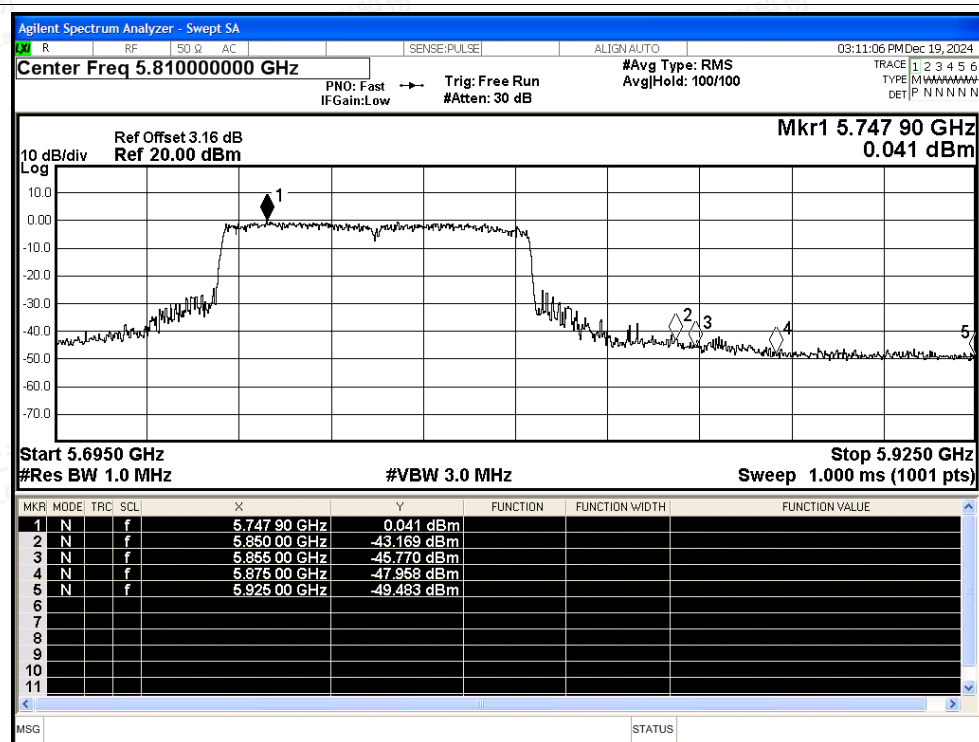

Restrict Band NVNT ac80 5775MHz Ant2 Average

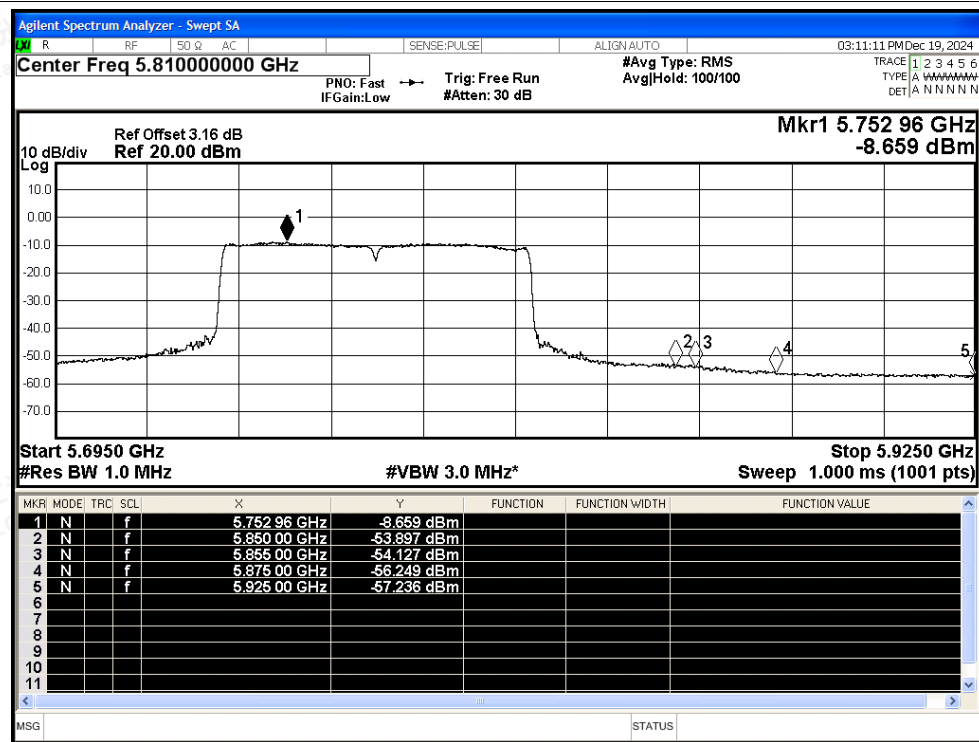

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant2 Peak

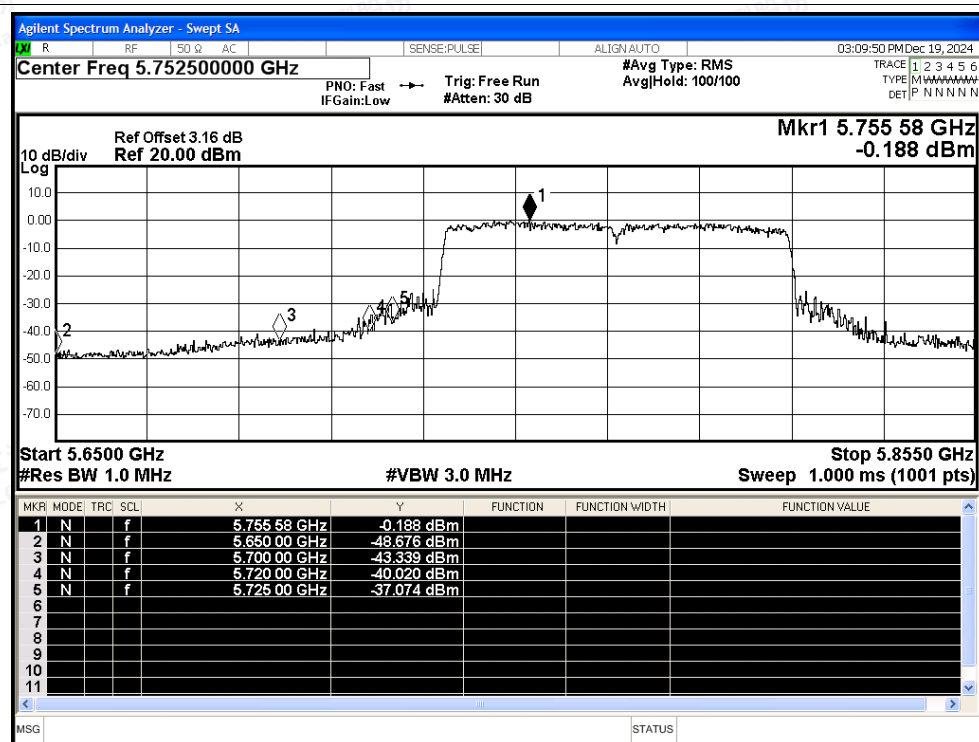

Restrict Band NVNT ac80 5775MHz Ant2 Average

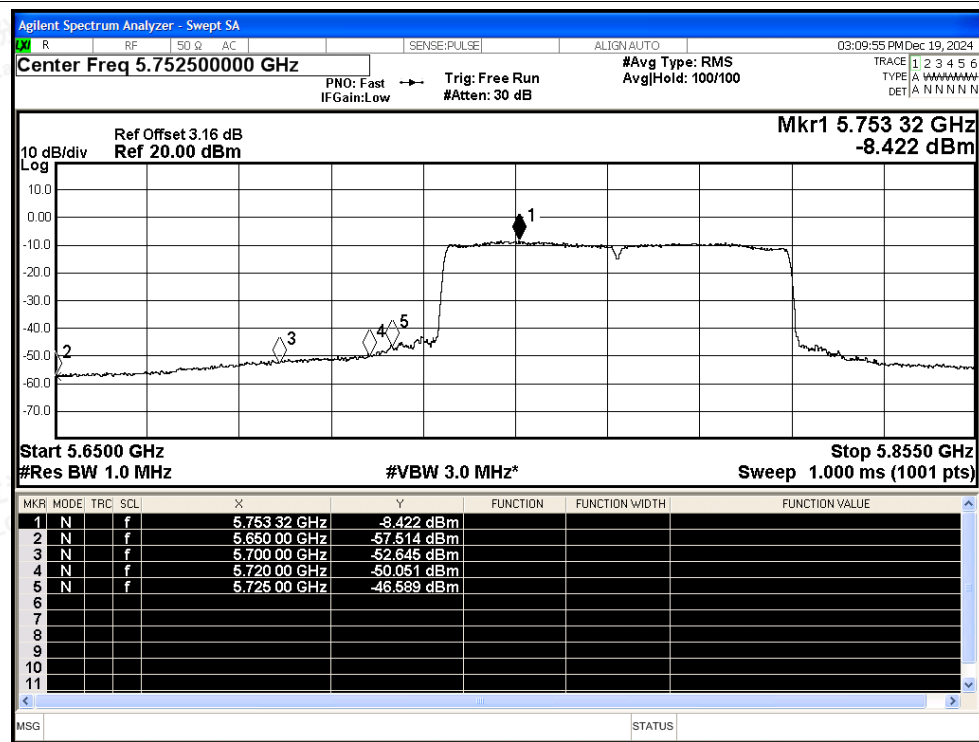

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant2 Peak

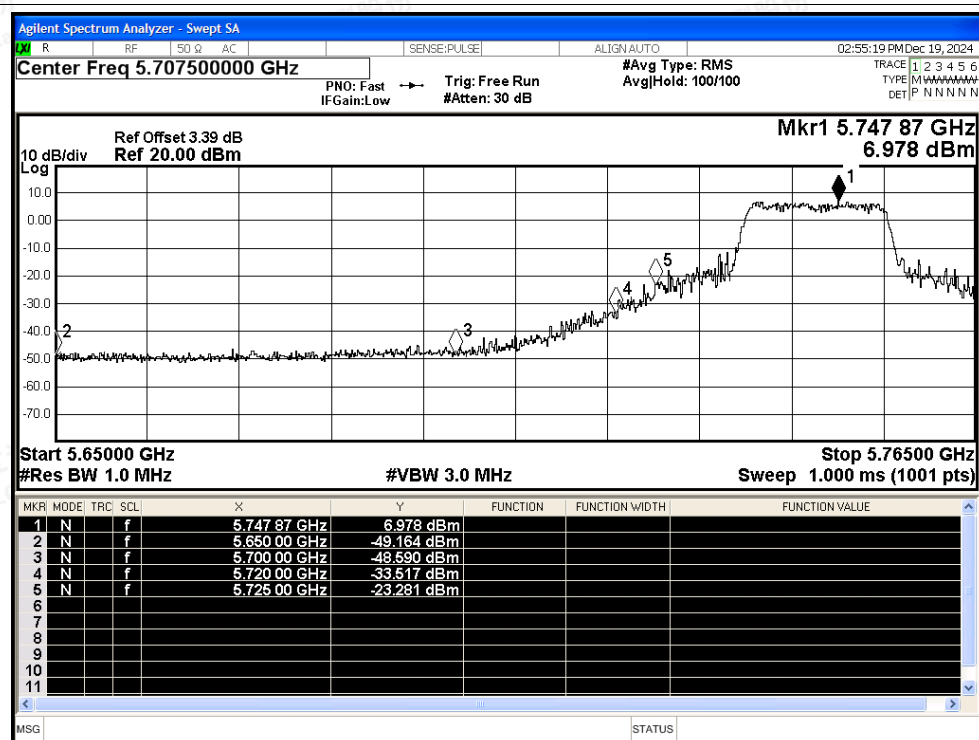

Restrict Band NVNT ax20 5745MHz Ant2 Average

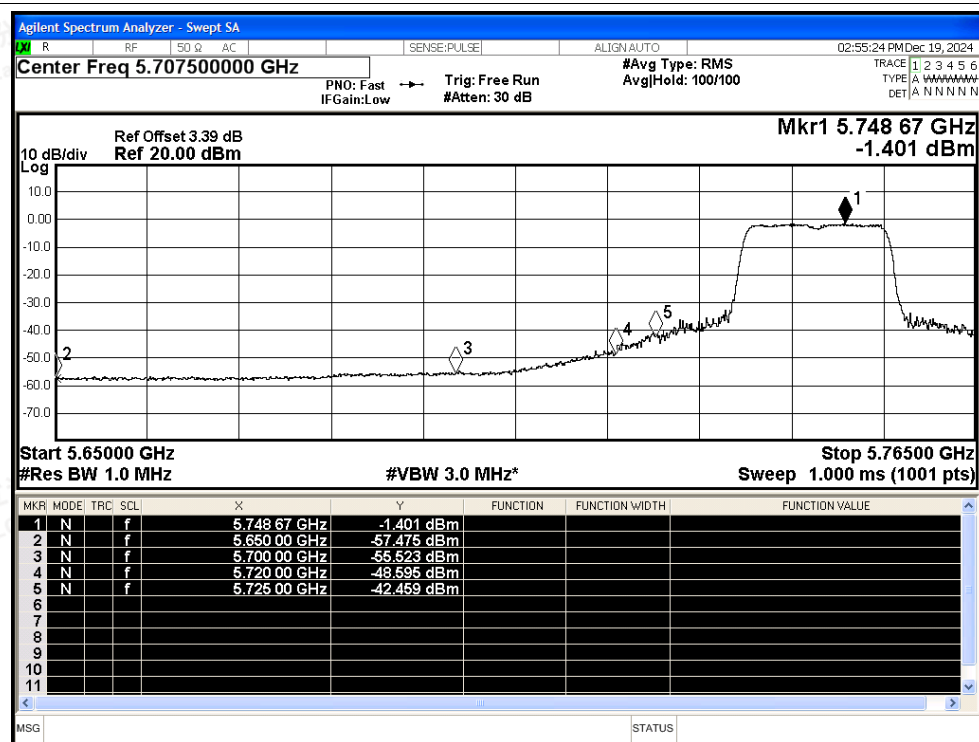

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant2 Peak

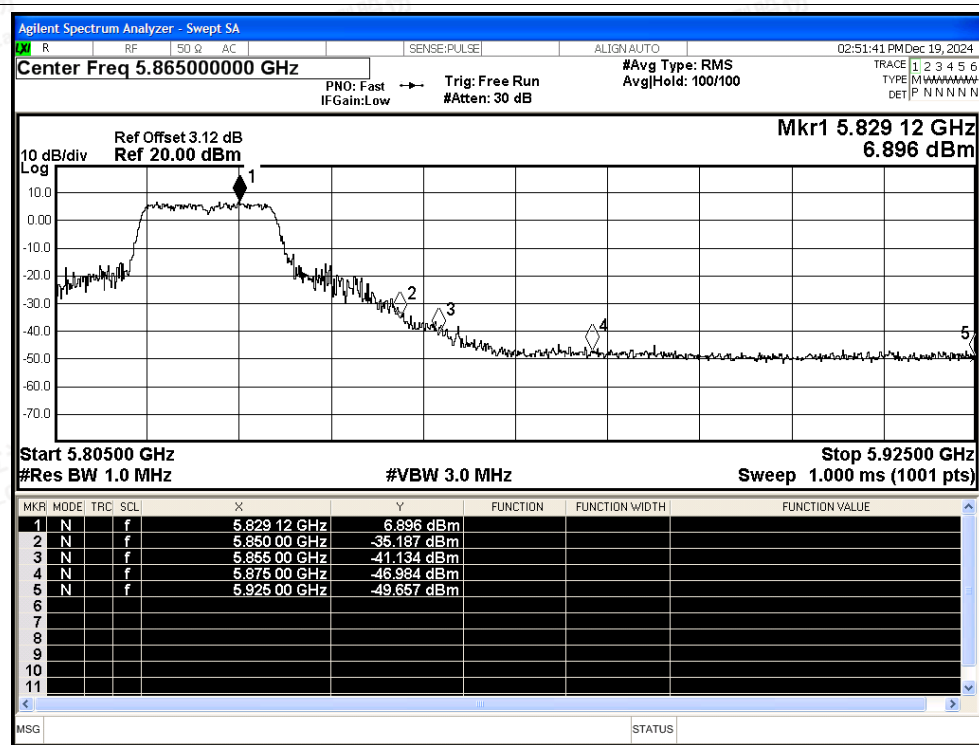

Restrict Band NVNT ax20 5825MHz Ant2 Average

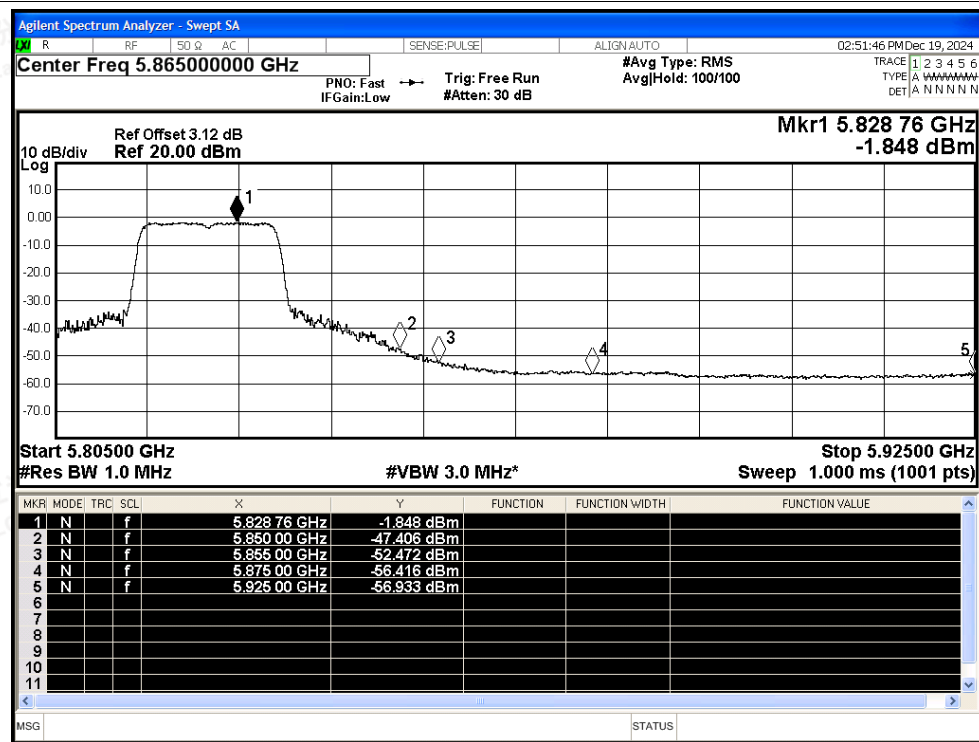

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant2 Peak

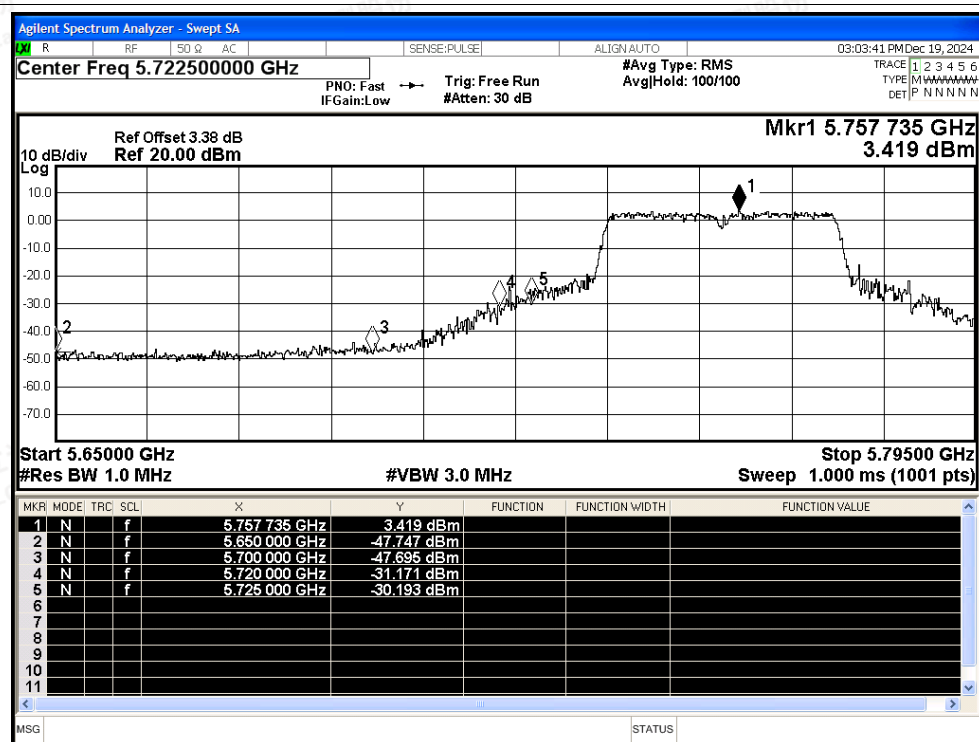

Restrict Band NVNT ax40 5755MHz Ant2 Average

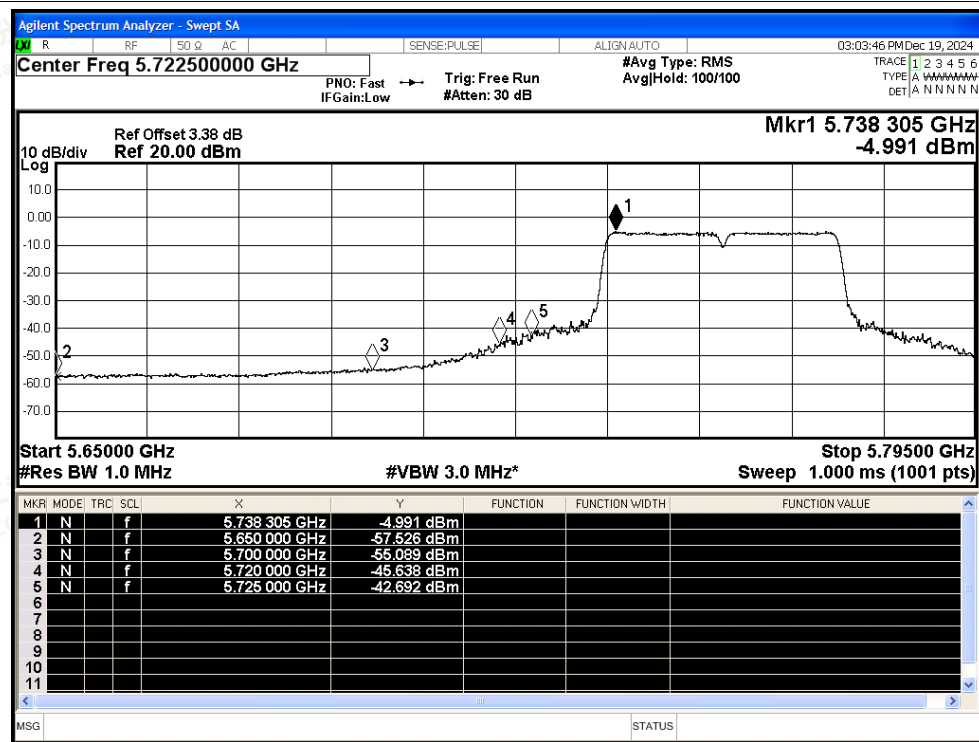

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant2 Peak

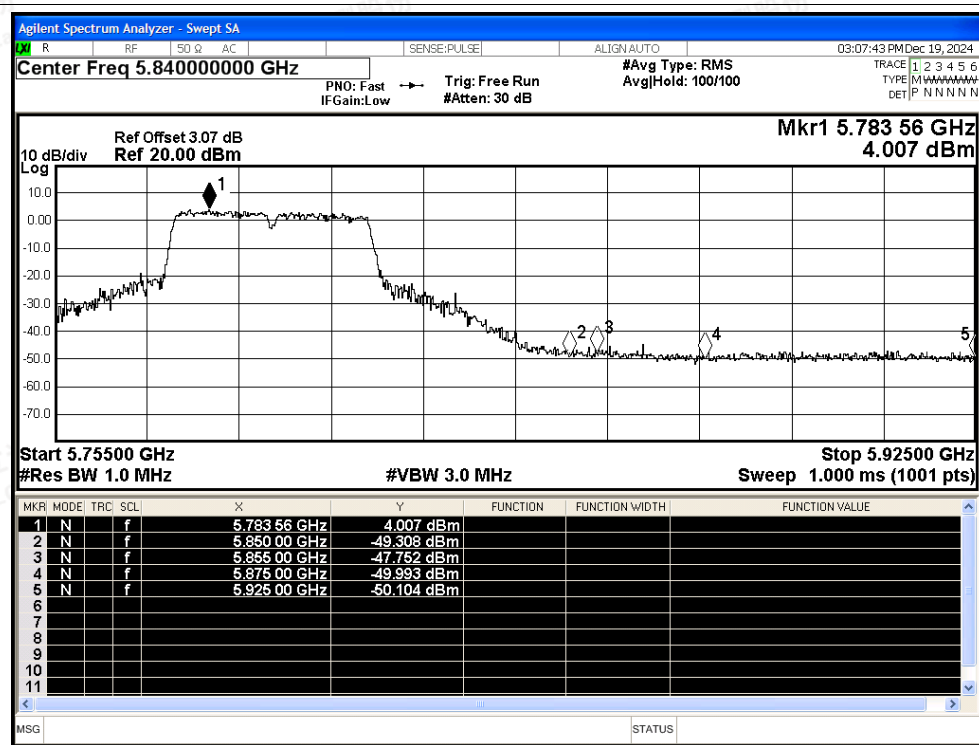

Restrict Band NVNT ax40 5795MHz Ant2 Average

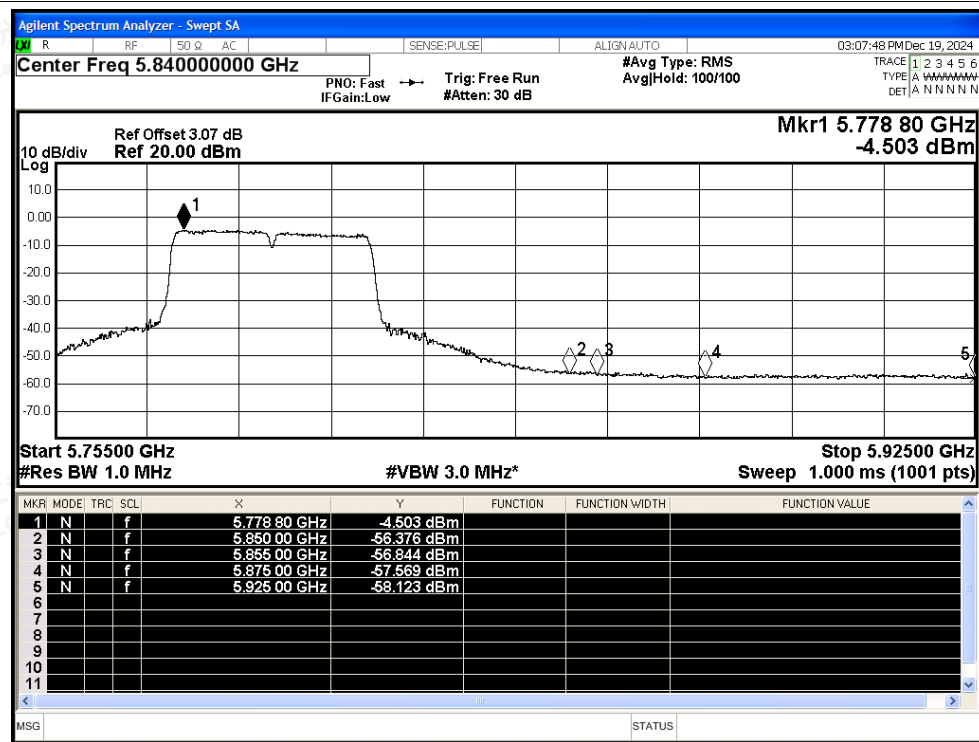

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant2 Peak

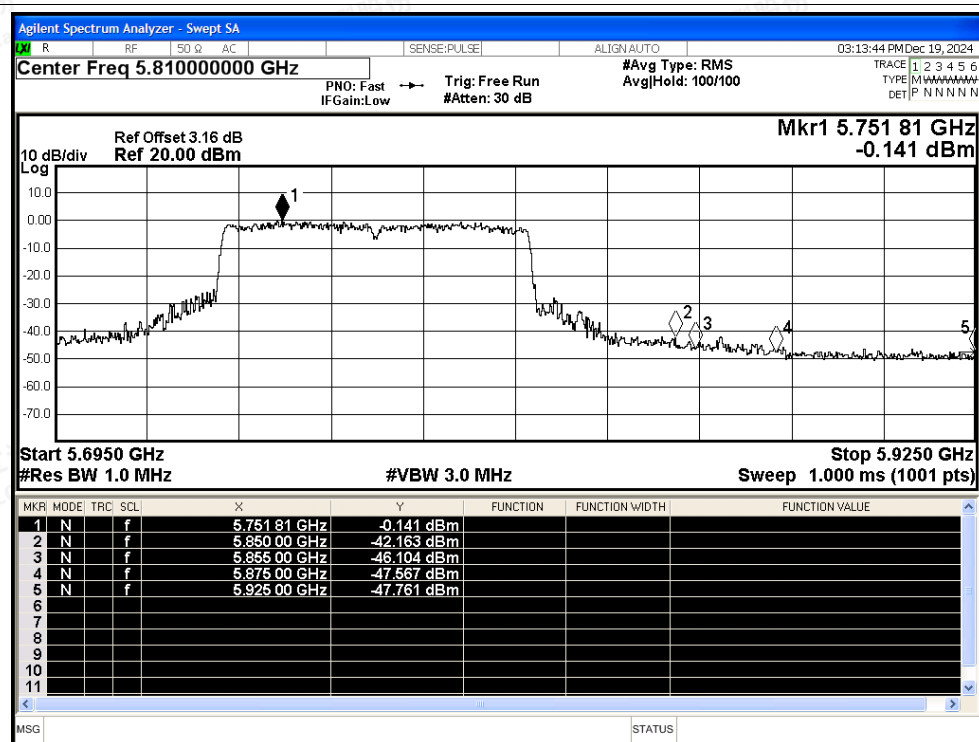

Restrict Band NVNT ax80 5775MHz Ant2 Average

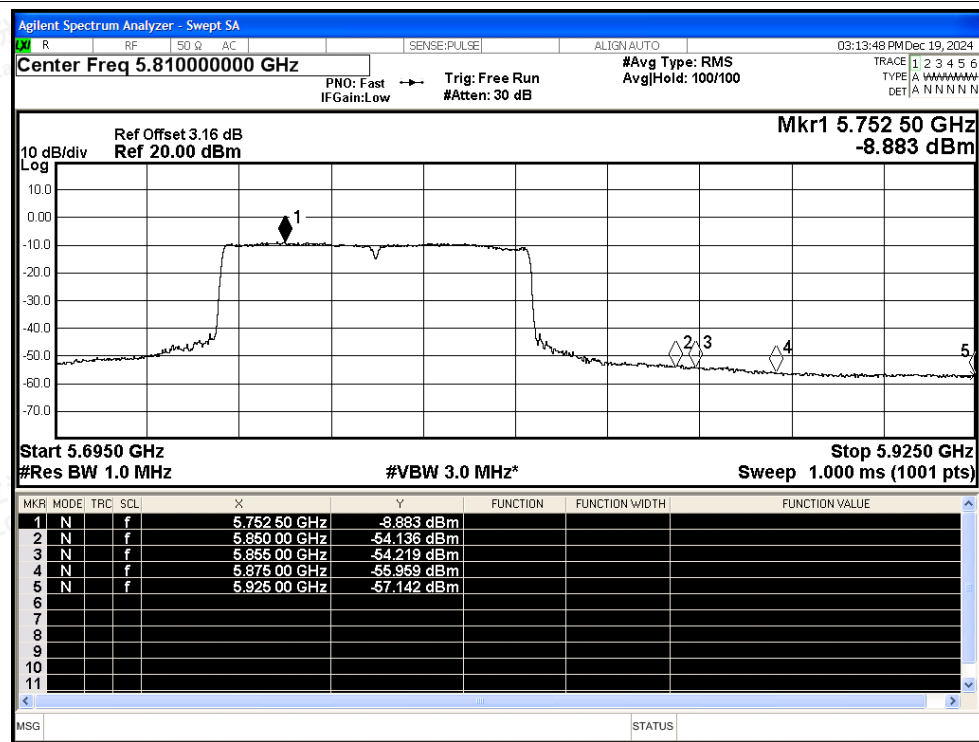

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant2 Peak

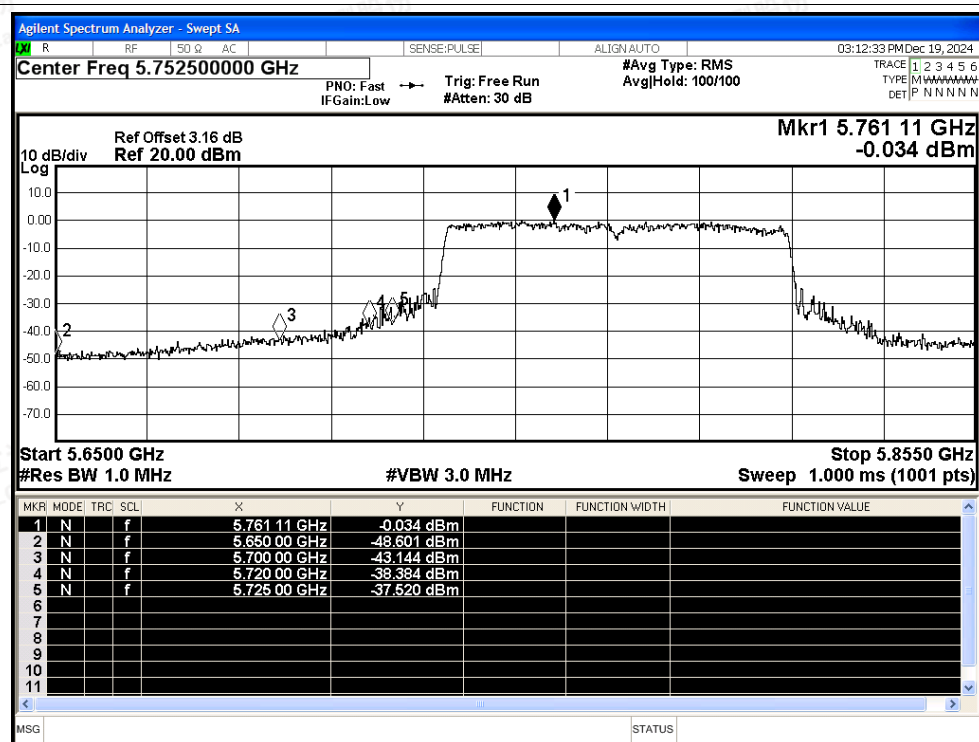

Restrict Band NVNT ax80 5775MHz Ant2 Average

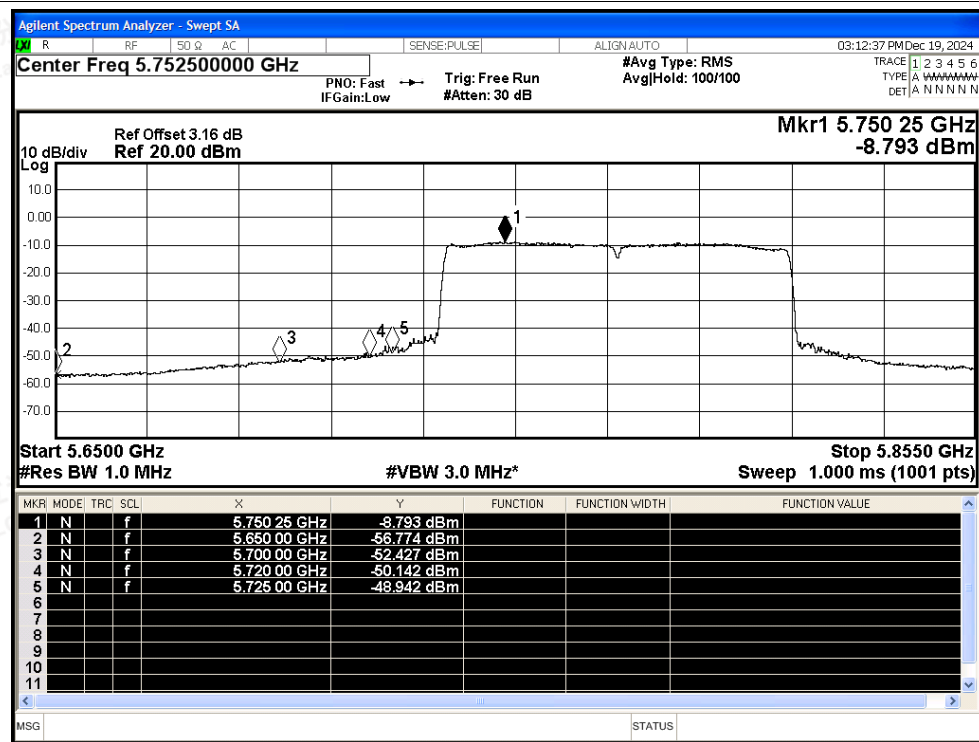

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	ANT1 Power (dBm)	ANT2 Power (dBm)	Gain (dBi)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	n20	5745	5650	-50.36	-49.11	3	-43.68	Peak	-27	Pass
NVNT	n20	5745	5650	-57.3	-57.62	3	-51.45	Average	-27	Pass
NVNT	n20	5745	5700	-48.13	-47.74	3	-41.92	Peak	10	Pass
NVNT	n20	5745	5700	-55.25	-55.64	3	-49.43	Average	10	Pass
NVNT	n20	5745	5720	-31.77	-31.08	3	-25.40	Peak	15.6	Pass
NVNT	n20	5745	5720	-44.95	-47.71	3	-40.10	Average	15.6	Pass
NVNT	n20	5745	5725	-24.02	-28.55	3	-19.71	Peak	27	Pass
NVNT	n20	5745	5725	-40.12	-40.99	3	-34.52	Average	27	Pass
NVNT	n20	5825	5850	-32.97	-29.48	3	-24.87	Peak	27	Pass
NVNT	n20	5825	5850	-46.19	-47.81	3	-40.91	Average	27	Pass
NVNT	n20	5825	5855	-37.35	-37.66	3	-31.49	Peak	15.6	Pass
NVNT	n20	5825	5855	-51.89	-51.57	3	-45.72	Average	15.6	Pass
NVNT	n20	5825	5875	-47.11	-48.9	3	-41.90	Peak	10	Pass
NVNT	n20	5825	5875	-56.06	-56.14	3	-50.09	Average	10	Pass
NVNT	n20	5825	5925	-48.68	-48.75	3	-42.70	Peak	-27	Pass
NVNT	n20	5825	5925	-56.92	-57.19	3	-51.04	Average	-27	Pass
NVNT	n40	5755	5650	-49.74	-48.79	3	-43.23	Peak	-27	Pass
NVNT	n40	5755	5650	-56.56	-57.84	3	-51.14	Average	-27	Pass
NVNT	n40	5755	5700	-47.02	-45.74	3	-40.32	Peak	10	Pass
NVNT	n40	5755	5700	-54.58	-54.64	3	-48.60	Average	10	Pass
NVNT	n40	5755	5720	-31.88	-32.57	3	-26.20	Peak	15.6	Pass
NVNT	n40	5755	5720	-46.38	-47.3	3	-40.81	Average	15.6	Pass
NVNT	n40	5755	5725	-27.69	-26.9	3	-21.27	Peak	27	Pass
NVNT	n40	5755	5725	-43.44	-43.48	3	-37.45	Average	27	Pass
NVNT	n40	5795	5850	-47.44	-47.64	3	-41.53	Peak	27	Pass
NVNT	n40	5795	5850	-55.29	-55.74	3	-49.50	Average	27	Pass
NVNT	n40	5795	5855	-46.05	-48.72	3	-41.17	Peak	15.6	Pass
NVNT	n40	5795	5855	-56.04	-56.15	3	-50.08	Average	15.6	Pass
NVNT	n40	5795	5875	-50.18	-50.51	3	-44.33	Peak	10	Pass
NVNT	n40	5795	5875	-57.37	-58.05	3	-51.69	Average	10	Pass
NVNT	n40	5795	5925	-50.87	-48.87	3	-43.75	Peak	-27	Pass
NVNT	n40	5795	5925	-57.26	-57.79	3	-51.51	Average	-27	Pass
NVNT	ac20	5745	5650	-49.37	-49.65	3	-43.50	Peak	-27	Pass
NVNT	ac20	5745	5650	-57.13	-57.51	3	-51.31	Average	-27	Pass
NVNT	ac20	5745	5700	-46.01	-46.65	3	-40.31	Peak	10	Pass
NVNT	ac20	5745	5700	-54.53	-55.34	3	-48.91	Average	10	Pass
NVNT	ac20	5745	5720	-30.42	-29.23	3	-23.77	Peak	15.6	Pass
NVNT	ac20	5745	5720	-43.42	-47.4	3	-38.96	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5745	5725	-26.55	-22.65	3	-18.17	Peak	27	Pass
NVNT	ac20	5745	5725	-39.34	-40.56	3	-33.90	Average	27	Pass
NVNT	ac20	5825	5850	-32	-33.17	3	-26.54	Peak	27	Pass
NVNT	ac20	5825	5850	-46.56	-48.52	3	-41.42	Average	27	Pass
NVNT	ac20	5825	5855	-38.32	-40.91	3	-33.41	Peak	15.6	Pass
NVNT	ac20	5825	5855	-51.6	-51.67	3	-45.62	Average	15.6	Pass
NVNT	ac20	5825	5875	-48.49	-47.52	3	-41.97	Peak	10	Pass
NVNT	ac20	5825	5875	-55.85	-56.24	3	-50.03	Average	10	Pass
NVNT	ac20	5825	5925	-47.74	-48.9	3	-42.27	Peak	-27	Pass
NVNT	ac20	5825	5925	-56.65	-56.83	3	-50.73	Average	-27	Pass
NVNT	ac40	5755	5650	-48.95	-49.39	3	-43.15	Peak	-27	Pass
NVNT	ac40	5755	5650	-57.37	-57.57	3	-51.46	Average	-27	Pass
NVNT	ac40	5755	5700	-47.59	-45.95	3	-40.68	Peak	10	Pass
NVNT	ac40	5755	5700	-55.02	-54.91	3	-48.95	Average	10	Pass
NVNT	ac40	5755	5720	-30.41	-32.29	3	-25.24	Peak	15.6	Pass
NVNT	ac40	5755	5720	-45.16	-46.23	3	-39.65	Average	15.6	Pass
NVNT	ac40	5755	5725	-23.64	-31.24	3	-19.94	Peak	27	Pass
NVNT	ac40	5755	5725	-42.91	-42.49	3	-36.68	Average	27	Pass
NVNT	ac40	5795	5850	-44.57	-47.66	3	-39.84	Peak	27	Pass
NVNT	ac40	5795	5850	-54.64	-56.03	3	-49.27	Average	27	Pass
NVNT	ac40	5795	5855	-48.54	-48.51	3	-42.51	Peak	15.6	Pass
NVNT	ac40	5795	5855	-55.03	-56.32	3	-49.62	Average	15.6	Pass
NVNT	ac40	5795	5875	-48.98	-48.76	3	-42.86	Peak	10	Pass
NVNT	ac40	5795	5875	-57.67	-57.64	3	-51.64	Average	10	Pass
NVNT	ac40	5795	5925	-49.44	-50.07	3	-43.73	Peak	-27	Pass
NVNT	ac40	5795	5925	-57.86	-57.29	3	-51.56	Average	-27	Pass
NVNT	ac80	5775	5850	-42.93	-43.17	3	-37.04	Peak	27	Pass
NVNT	ac80	5775	5850	-51.21	-53.9	3	-46.34	Average	27	Pass
NVNT	ac80	5775	5855	-40.55	-45.77	3	-36.41	Peak	15.6	Pass
NVNT	ac80	5775	5855	-52.12	-54.13	3	-47.00	Average	15.6	Pass
NVNT	ac80	5775	5875	-47.14	-47.96	3	-41.52	Peak	10	Pass
NVNT	ac80	5775	5875	-55.01	-56.25	3	-49.58	Average	10	Pass
NVNT	ac80	5775	5925	-50.4	-49.48	3	-43.91	Peak	-27	Pass
NVNT	ac80	5775	5925	-56.62	-57.24	3	-50.91	Average	-27	Pass
NVNT	ac80	5775	5650	-47.71	-48.68	3	-42.16	Peak	-27	Pass
NVNT	ac80	5775	5650	-56.52	-57.51	3	-50.98	Average	-27	Pass
NVNT	ac80	5775	5700	-43.61	-43.34	3	-37.46	Peak	10	Pass
NVNT	ac80	5775	5700	-53.03	-52.65	3	-46.83	Average	10	Pass
NVNT	ac80	5775	5720	-37.98	-40.02	3	-32.87	Peak	15.6	Pass
NVNT	ac80	5775	5720	-48.75	-50.05	3	-43.34	Average	15.6	Pass
NVNT	ac80	5775	5725	-35.27	-37.07	3	-30.07	Peak	27	Pass
NVNT	ac80	5775	5725	-46.85	-46.59	3	-40.71	Average	27	Pass
NVNT	ax20	5745	5650	-48.88	-49.16	3	-43.01	Peak	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5745	5650	-56.92	-57.48	3	-51.18	Average	-27	Pass
NVNT	ax20	5745	5700	-46.82	-48.59	3	-41.61	Peak	10	Pass
NVNT	ax20	5745	5700	-54.68	-55.52	3	-49.07	Average	10	Pass
NVNT	ax20	5745	5720	-30.25	-33.52	3	-25.57	Peak	15.6	Pass
NVNT	ax20	5745	5720	-44.68	-48.6	3	-40.20	Average	15.6	Pass
NVNT	ax20	5745	5725	-21.84	-23.28	3	-16.49	Peak	27	Pass
NVNT	ax20	5745	5725	-39.33	-42.46	3	-34.61	Average	27	Pass
NVNT	ax20	5825	5850	-28.7	-35.19	3	-24.82	Peak	27	Pass
NVNT	ax20	5825	5850	-46.89	-47.41	3	-41.13	Average	27	Pass
NVNT	ax20	5825	5855	-38.92	-41.13	3	-33.88	Peak	15.6	Pass
NVNT	ax20	5825	5855	-51.69	-52.47	3	-46.05	Average	15.6	Pass
NVNT	ax20	5825	5875	-46.92	-46.98	3	-40.94	Peak	10	Pass
NVNT	ax20	5825	5875	-55.17	-56.42	3	-49.74	Average	10	Pass
NVNT	ax20	5825	5925	-50.09	-49.66	3	-43.86	Peak	-27	Pass
NVNT	ax20	5825	5925	-56.15	-56.93	3	-50.51	Average	-27	Pass
NVNT	ax40	5755	5650	-49.37	-47.75	3	-42.47	Peak	-27	Pass
NVNT	ax40	5755	5650	-56.6	-57.53	3	-51.03	Average	-27	Pass
NVNT	ax40	5755	5700	-48.31	-47.7	3	-41.98	Peak	10	Pass
NVNT	ax40	5755	5700	-54.6	-55.09	3	-48.83	Average	10	Pass
NVNT	ax40	5755	5720	-31.71	-31.17	3	-25.42	Peak	15.6	Pass
NVNT	ax40	5755	5720	-45.4	-45.64	3	-39.51	Average	15.6	Pass
NVNT	ax40	5755	5725	-26.07	-30.19	3	-21.65	Peak	27	Pass
NVNT	ax40	5755	5725	-42.08	-42.69	3	-36.36	Average	27	Pass
NVNT	ax40	5795	5850	-47.69	-49.31	3	-42.41	Peak	27	Pass
NVNT	ax40	5795	5850	-54.59	-56.38	3	-49.38	Average	27	Pass
NVNT	ax40	5795	5855	-46.77	-47.75	3	-41.22	Peak	15.6	Pass
NVNT	ax40	5795	5855	-55.41	-56.84	3	-50.06	Average	15.6	Pass
NVNT	ax40	5795	5875	-49.29	-49.99	3	-43.62	Peak	10	Pass
NVNT	ax40	5795	5875	-57.63	-57.57	3	-51.59	Average	10	Pass
NVNT	ax40	5795	5925	-48.29	-50.1	3	-43.09	Peak	-27	Pass
NVNT	ax40	5795	5925	-57.35	-58.12	3	-51.71	Average	-27	Pass
NVNT	ax80	5775	5850	-44	-42.16	3	-36.97	Peak	27	Pass
NVNT	ax80	5775	5850	-51.2	-54.14	3	-46.42	Average	27	Pass
NVNT	ax80	5775	5855	-43.03	-46.1	3	-38.29	Peak	15.6	Pass
NVNT	ax80	5775	5855	-52.13	-54.22	3	-47.04	Average	15.6	Pass
NVNT	ax80	5775	5875	-47.68	-47.57	3	-41.61	Peak	10	Pass
NVNT	ax80	5775	5875	-55.12	-55.96	3	-49.51	Average	10	Pass
NVNT	ax80	5775	5925	-50.09	-47.76	3	-42.76	Peak	-27	Pass
NVNT	ax80	5775	5925	-57.48	-57.14	3	-51.30	Average	-27	Pass
NVNT	ax80	5775	5650	-47.76	-48.6	3	-42.15	Peak	-27	Pass
NVNT	ax80	5775	5650	-56.37	-56.77	3	-50.56	Average	-27	Pass
NVNT	ax80	5775	5700	-45.74	-43.14	3	-38.24	Peak	10	Pass
NVNT	ax80	5775	5700	-52.73	-52.43	3	-46.57	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5775	5720	-35.8	-38.38	3	-30.89	Peak	15.6	Pass
NVNT	ax80	5775	5720	-47.86	-50.14	3	-42.84	Average	15.6	Pass
NVNT	ax80	5775	5725	-34.71	-37.52	3	-29.88	Peak	27	Pass
NVNT	ax80	5775	5725	-47.01	-48.94	3	-41.86	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



G.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant1	5745	0	0	25	Pass
NVNT	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
NVNT	n20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
NVNT	n40	5755	Ant1	5755	0	0	25	Pass
NVNT	n40	5795	Ant1	5794.92	-80000	-13.81	25	Pass
NVNT	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
NVNT	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
NVNT	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
NVNT	ax20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	ax20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	ax20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	ax40	5755	Ant1	5755	0	0	25	Pass
NVNT	ax40	5795	Ant1	5795	0	0	25	Pass
NVNT	ax80	5775	Ant1	5775	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5745MHz Ant1

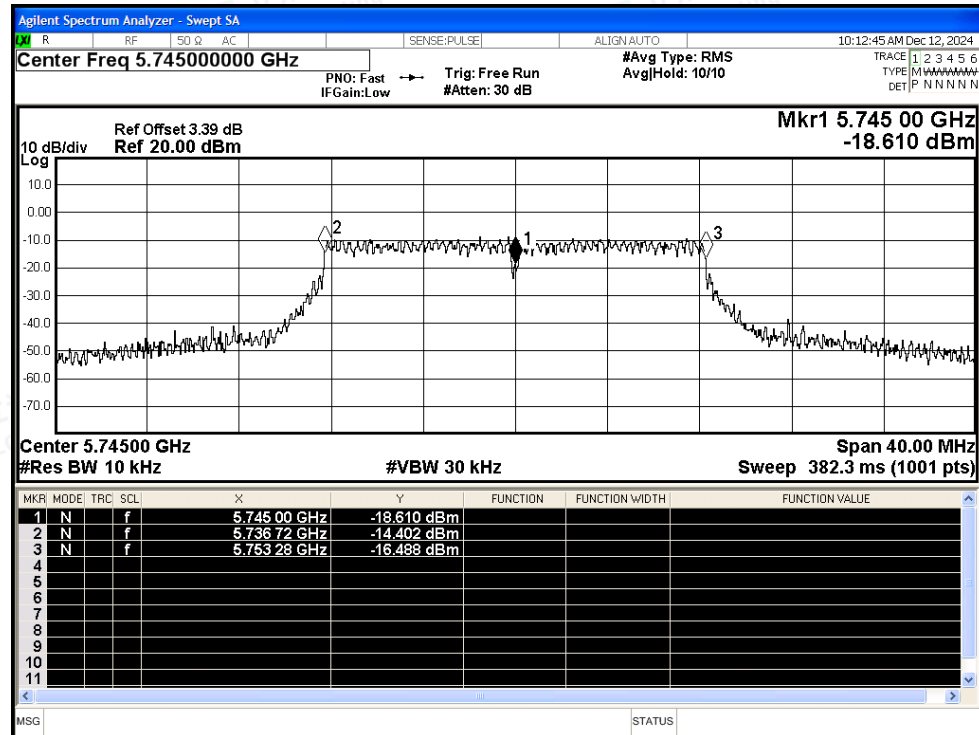

Freq. Stability NVNT a 5785MHz Ant1

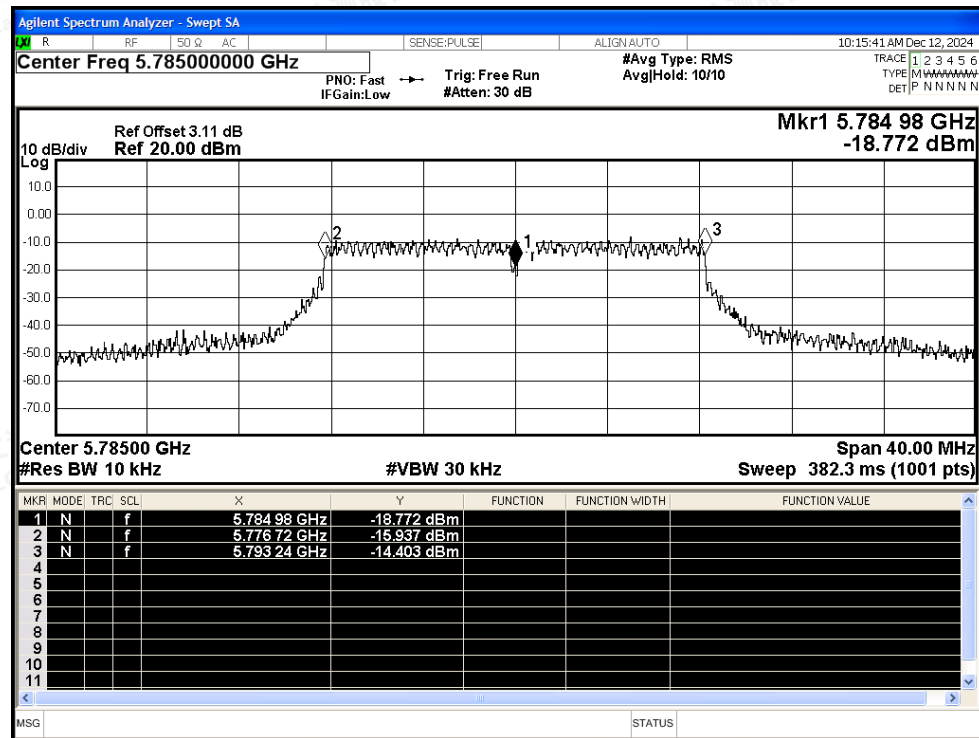

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant1

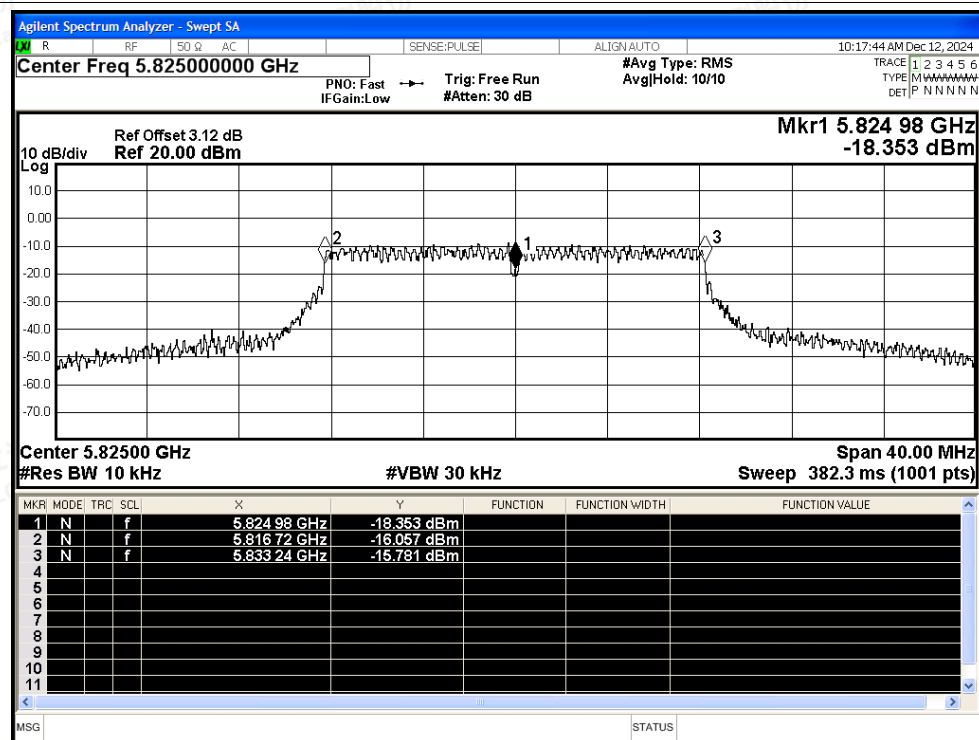

Freq. Stability NVNT n20 5745MHz Ant1

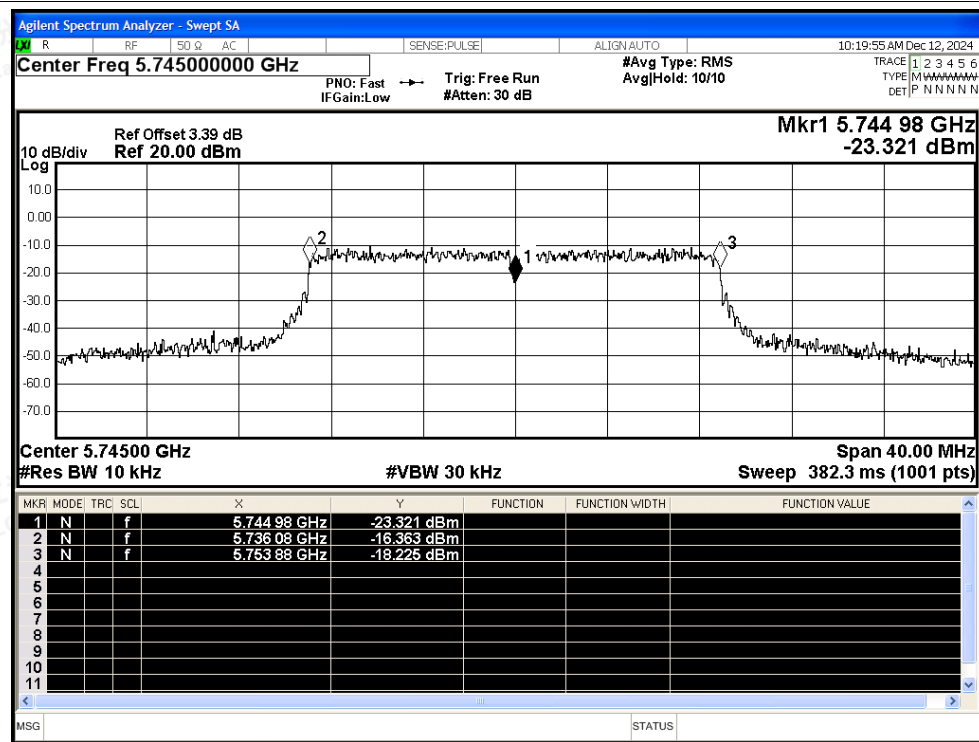

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant1

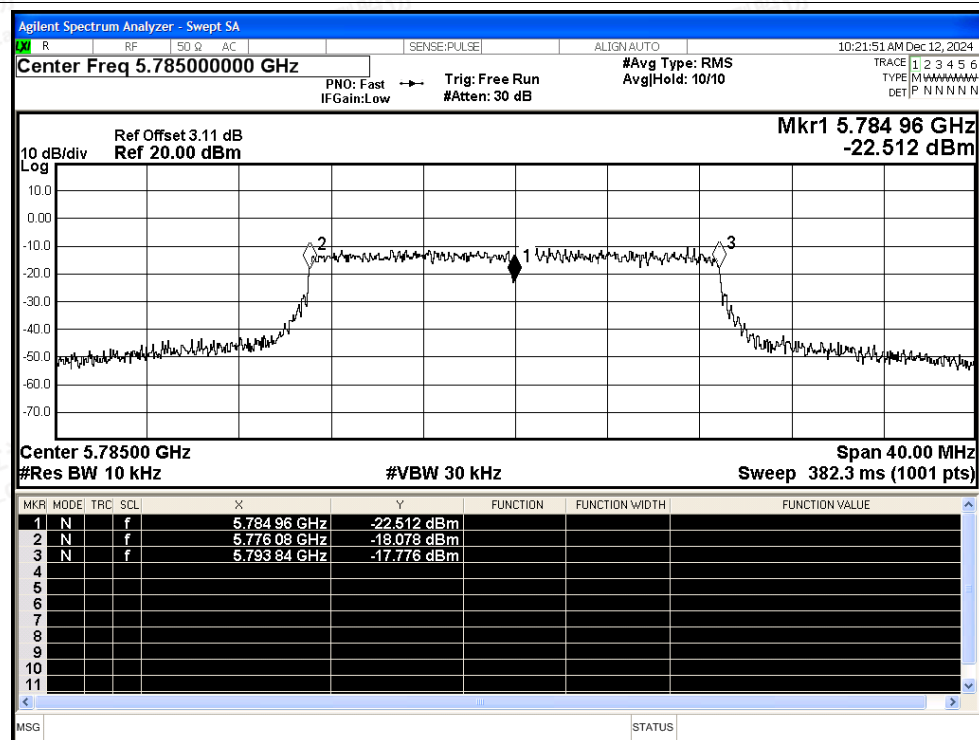

Freq. Stability NVNT n20 5825MHz Ant1

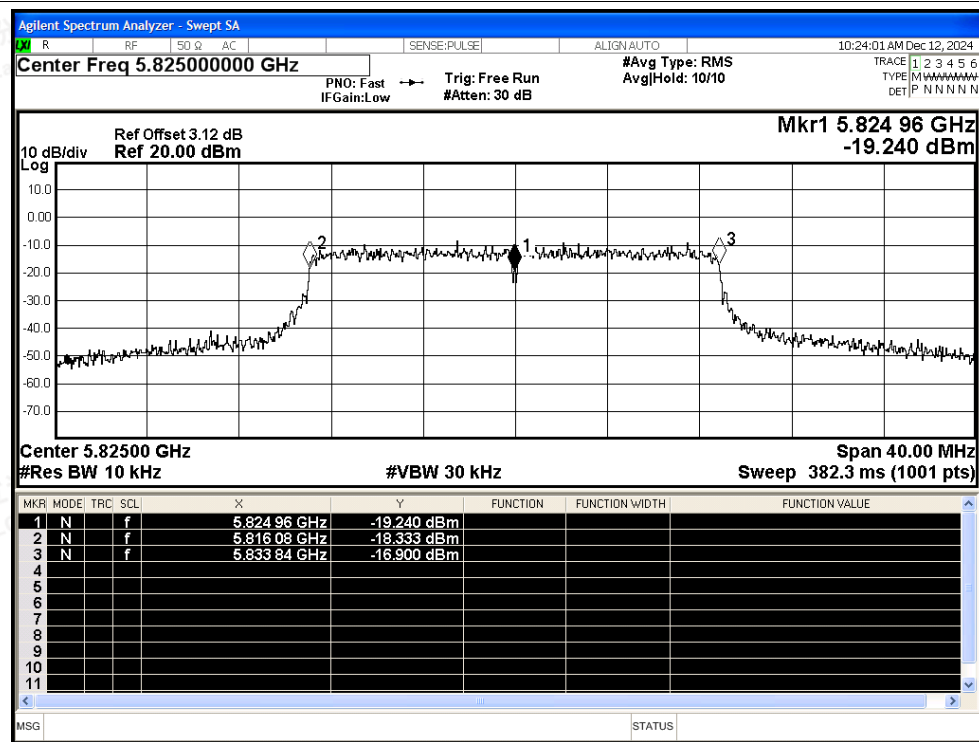

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant1

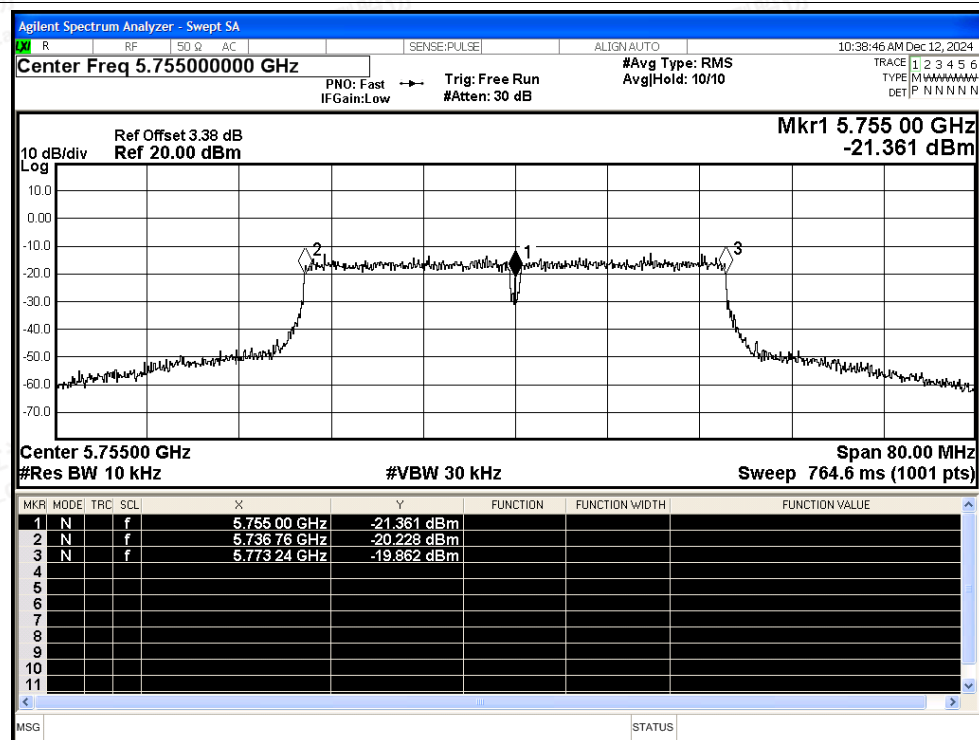

Freq. Stability NVNT n40 5795MHz Ant1

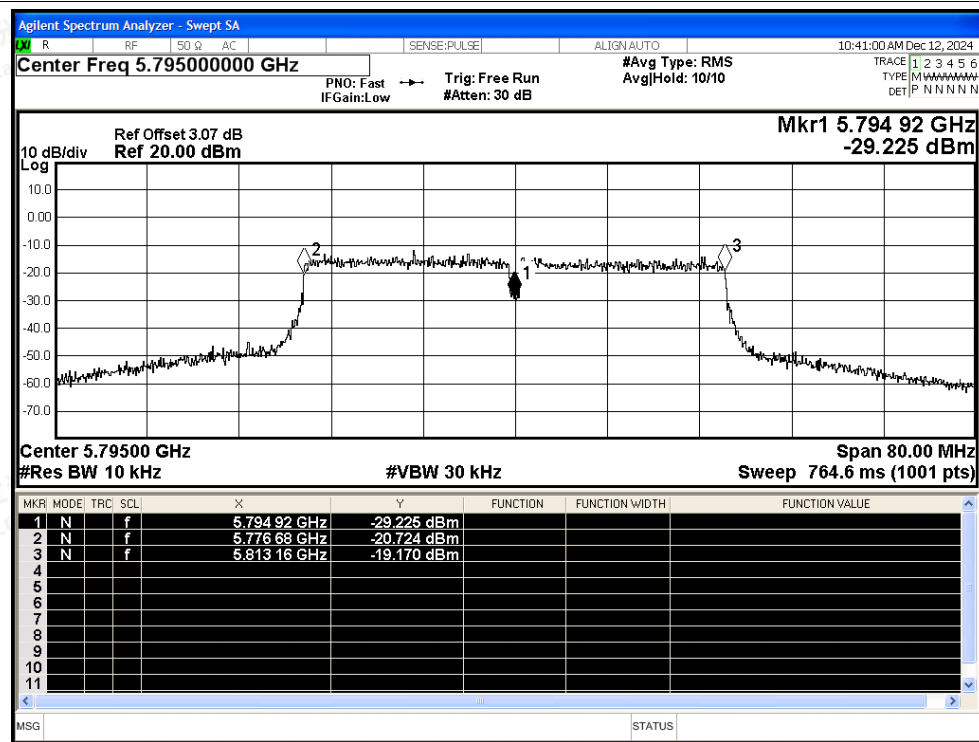

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant1

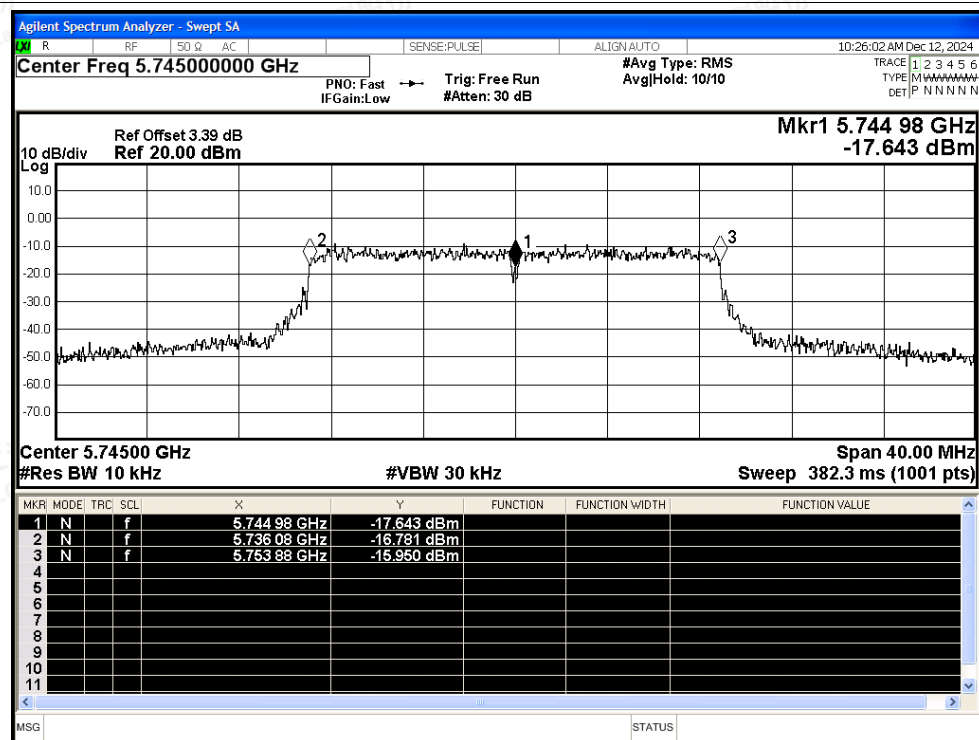

Freq. Stability NVNT ac20 5785MHz Ant1

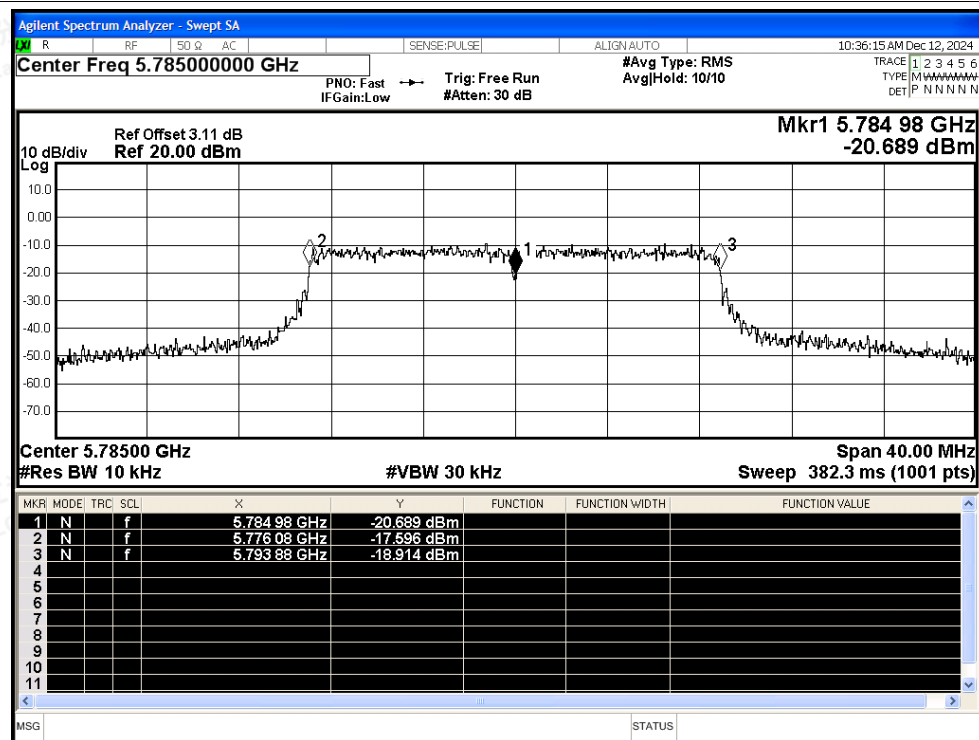

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant1

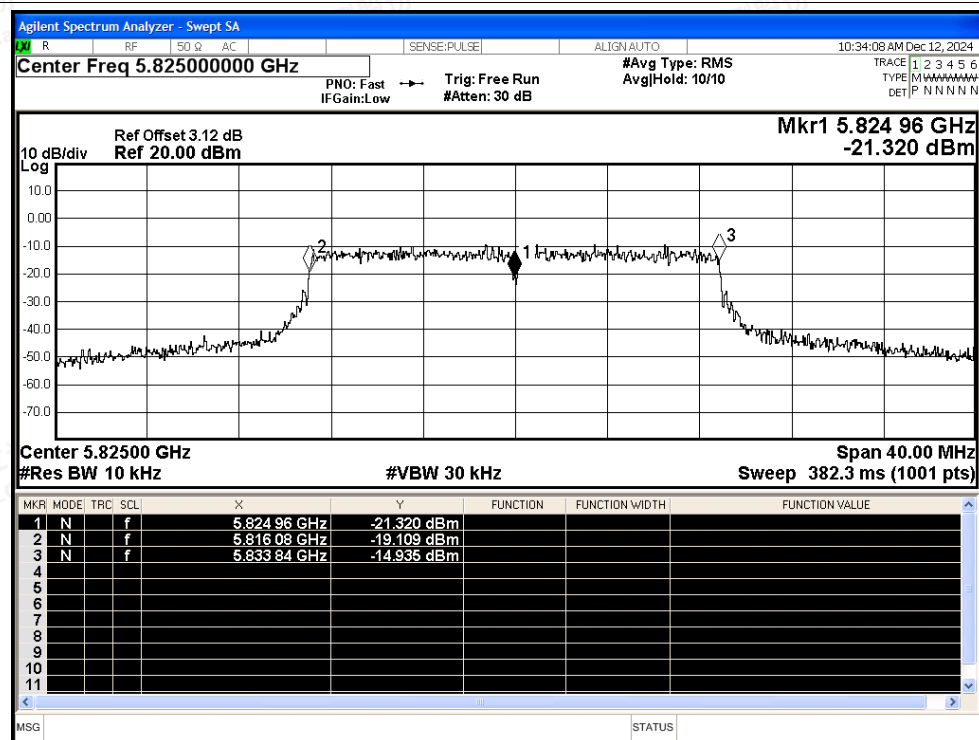

Freq. Stability NVNT ac40 5755MHz Ant1

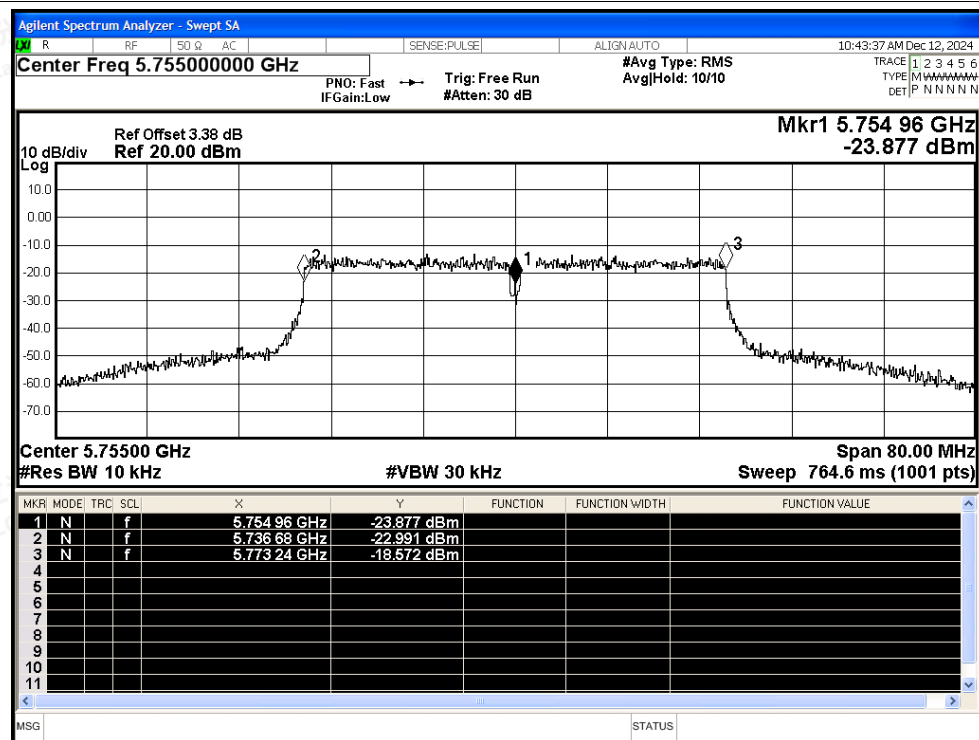

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant1

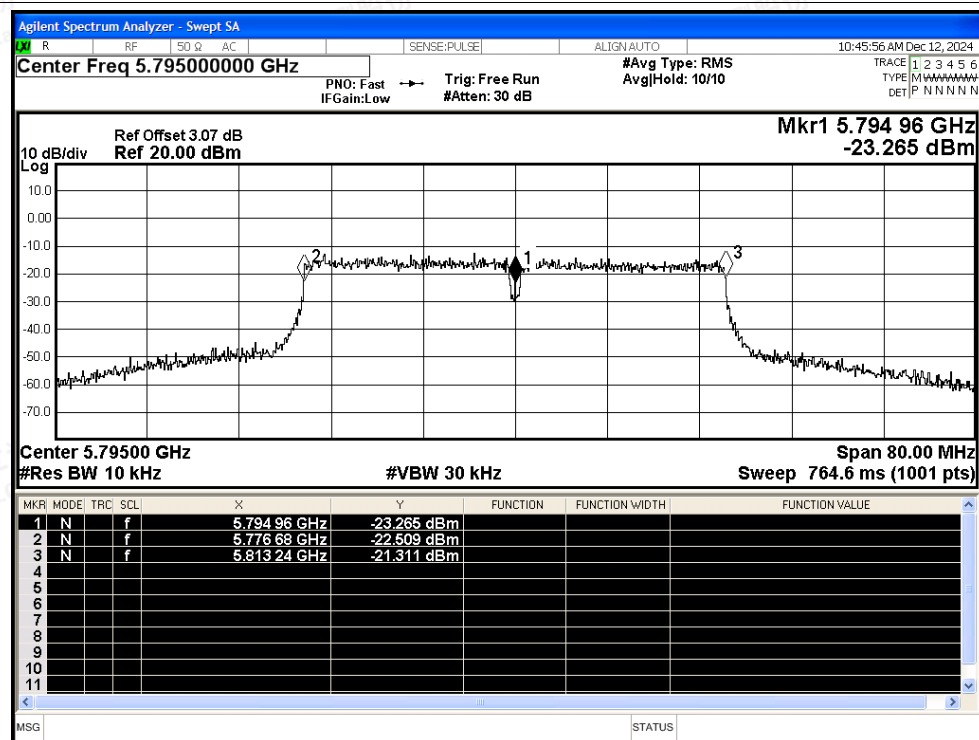

Freq. Stability NVNT ac80 5775MHz Ant1

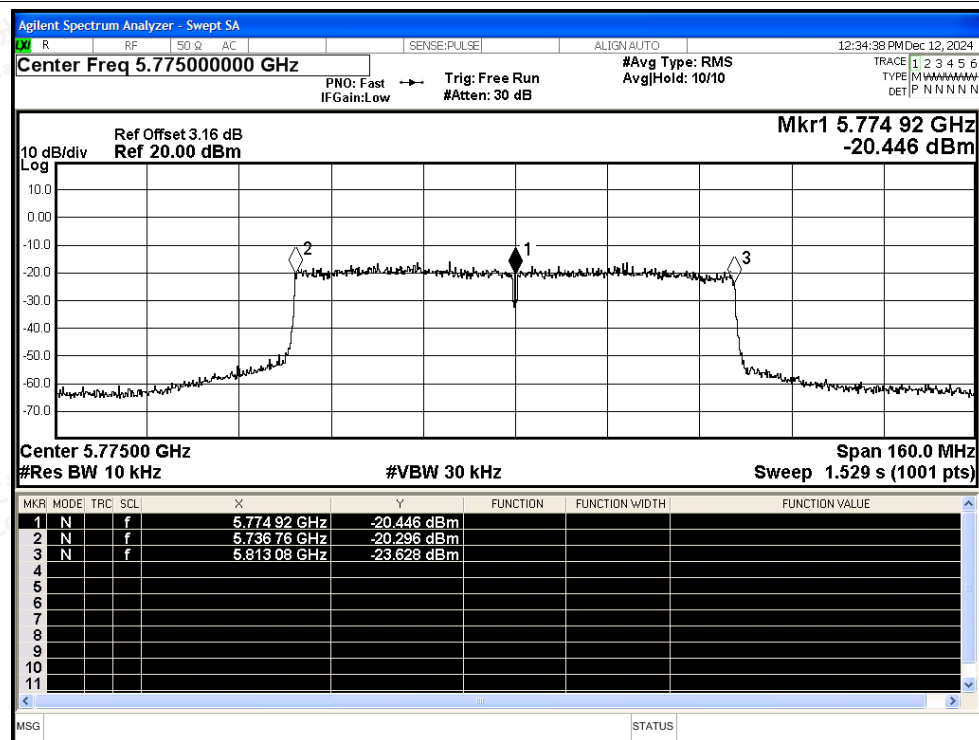

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant1

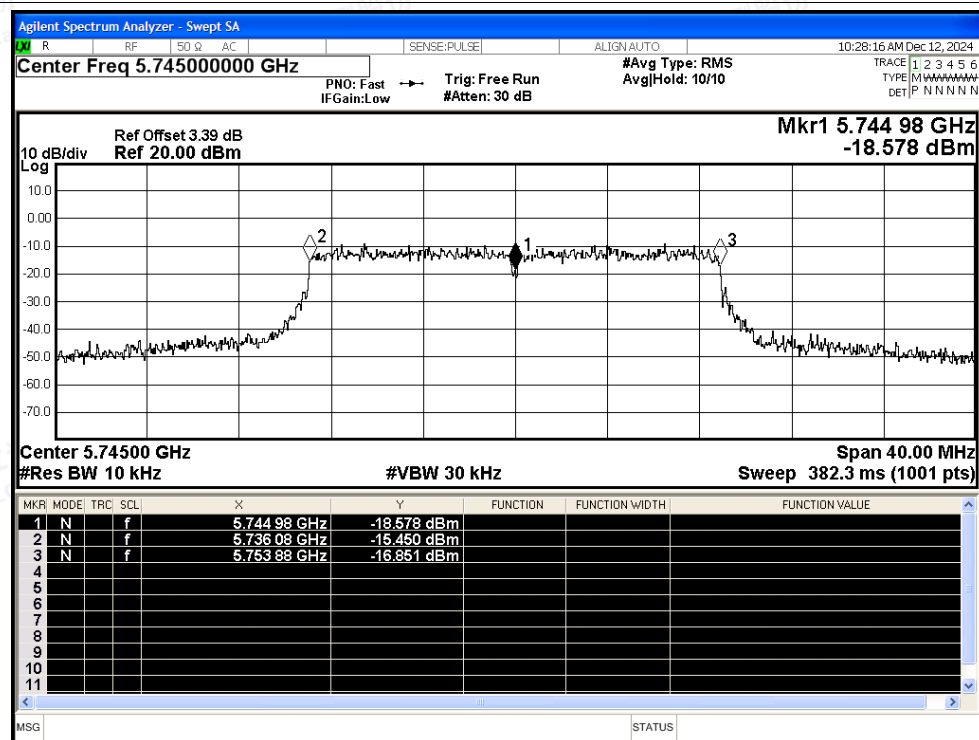

Freq. Stability NVNT ax20 5785MHz Ant1

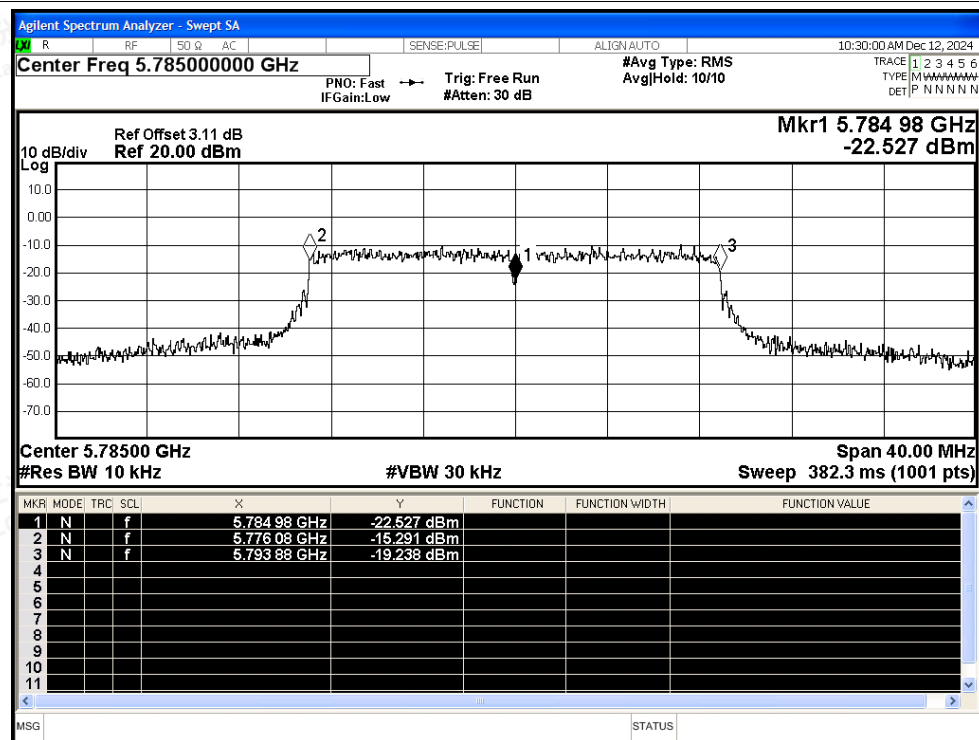

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5825MHz Ant1

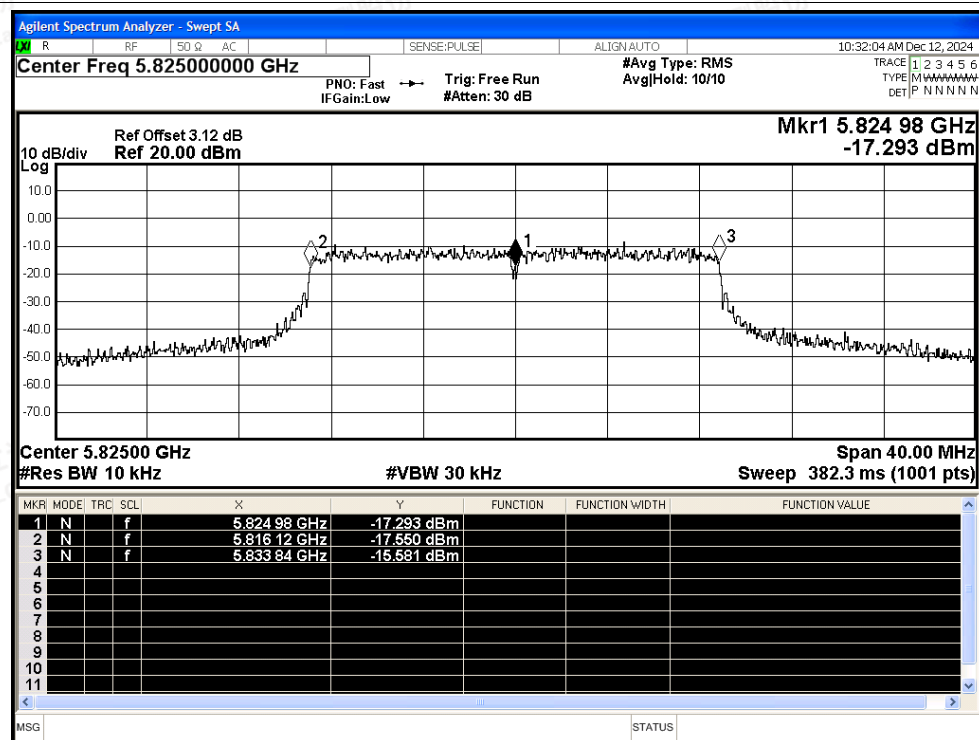

Freq. Stability NVNT ax40 5755MHz Ant1

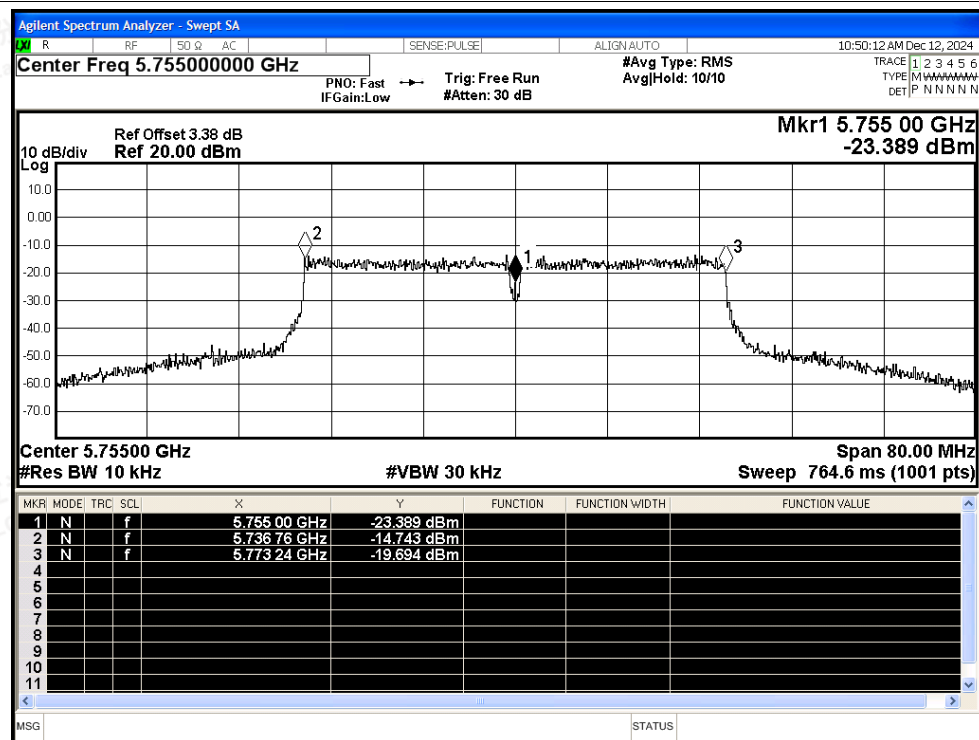

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5795MHz Ant1

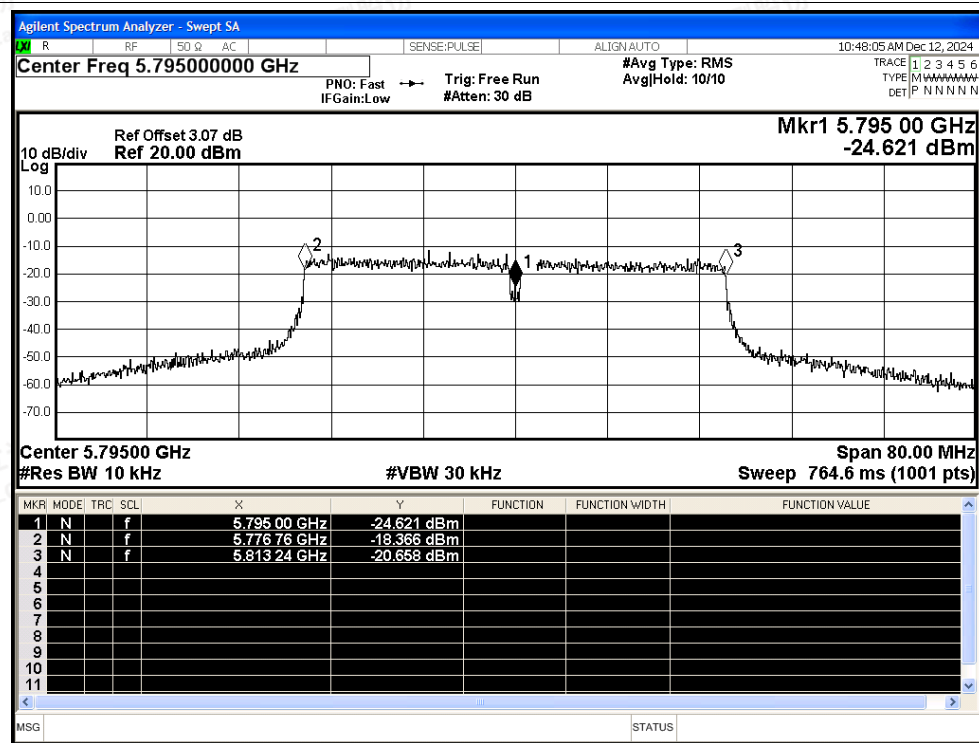

Freq. Stability NVNT ax80 5775MHz Ant1

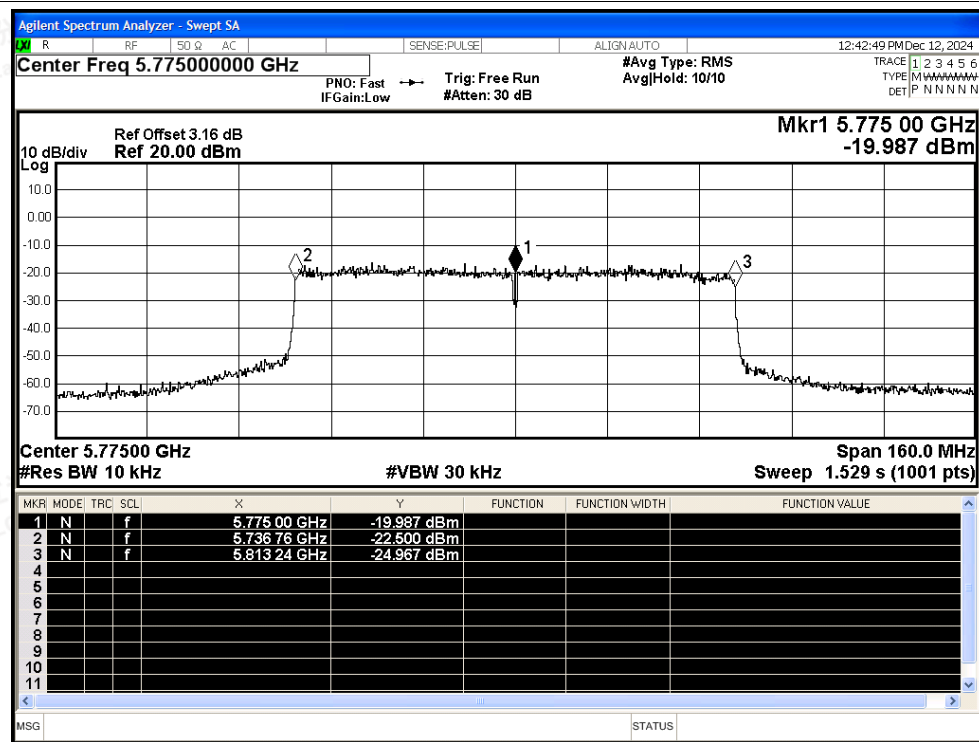

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant2	5744.98	-20000	-3.48	25	Pass
NVNT	a	5785	Ant2	5784.98	-20000	-3.46	25	Pass
NVNT	a	5825	Ant2	5825	0	0	25	Pass
NVNT	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
NVNT	n20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	n40	5795	Ant2	5795	0	0	25	Pass
NVNT	ac20	5745	Ant2	5745	0	0	25	Pass
NVNT	ac20	5785	Ant2	5784.96	-40000	-6.91	25	Pass
NVNT	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
NVNT	ac80	5775	Ant2	5775	0	0	25	Pass
NVNT	ax20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
NVNT	ax20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
NVNT	ax20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	ax40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	ax40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant2	5775	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5745MHz Ant2

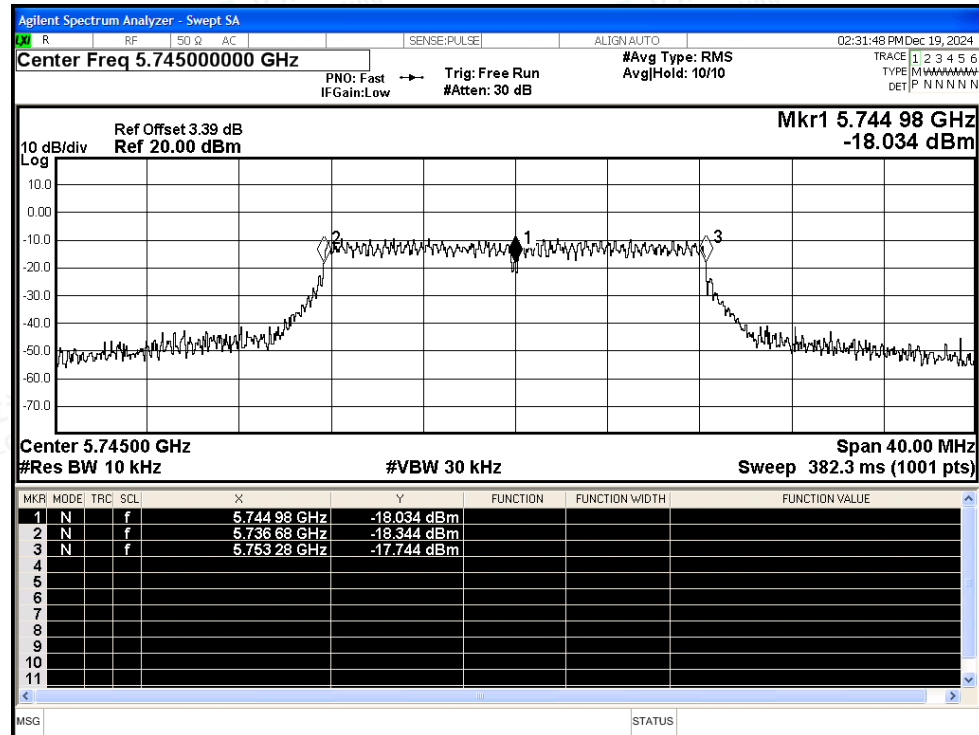

Freq. Stability NVNT a 5785MHz Ant2

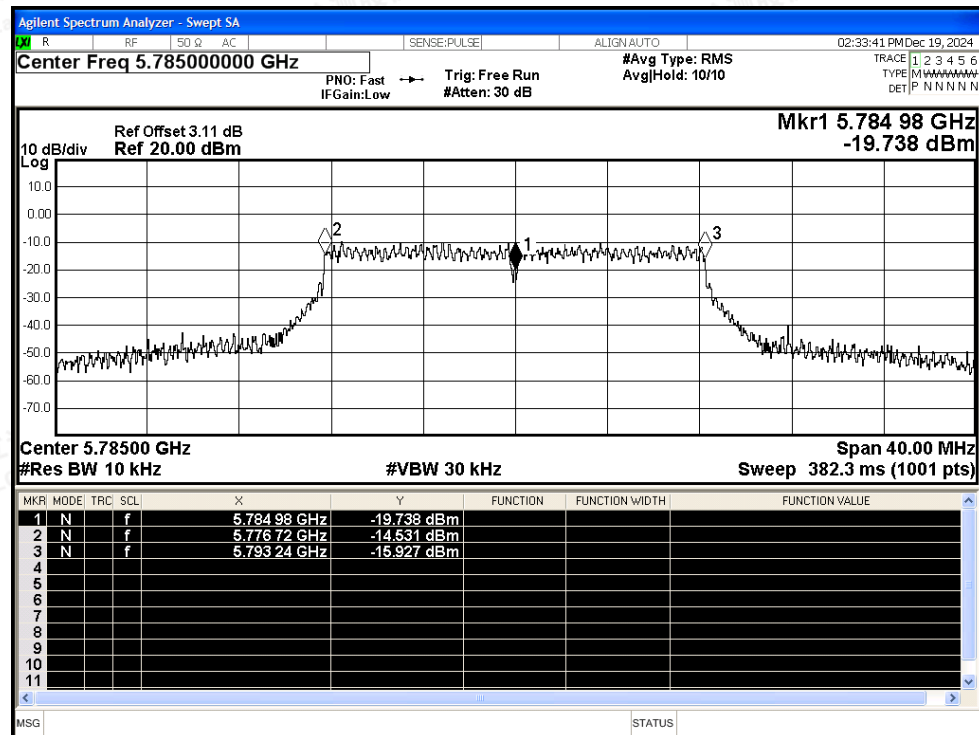

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant2

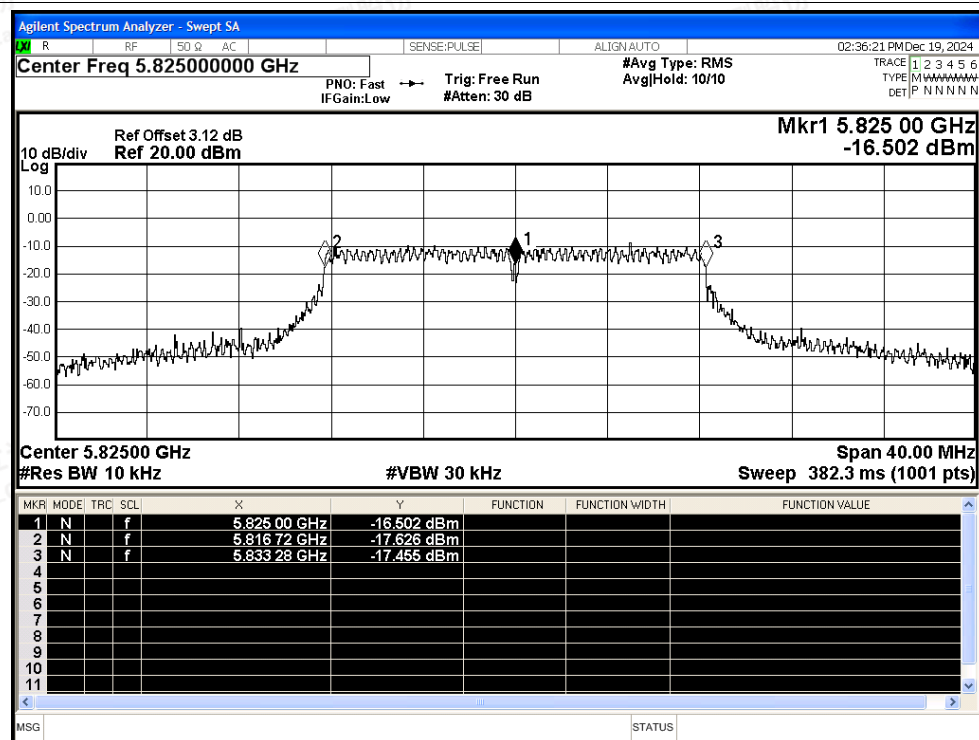

Freq. Stability NVNT n20 5745MHz Ant2

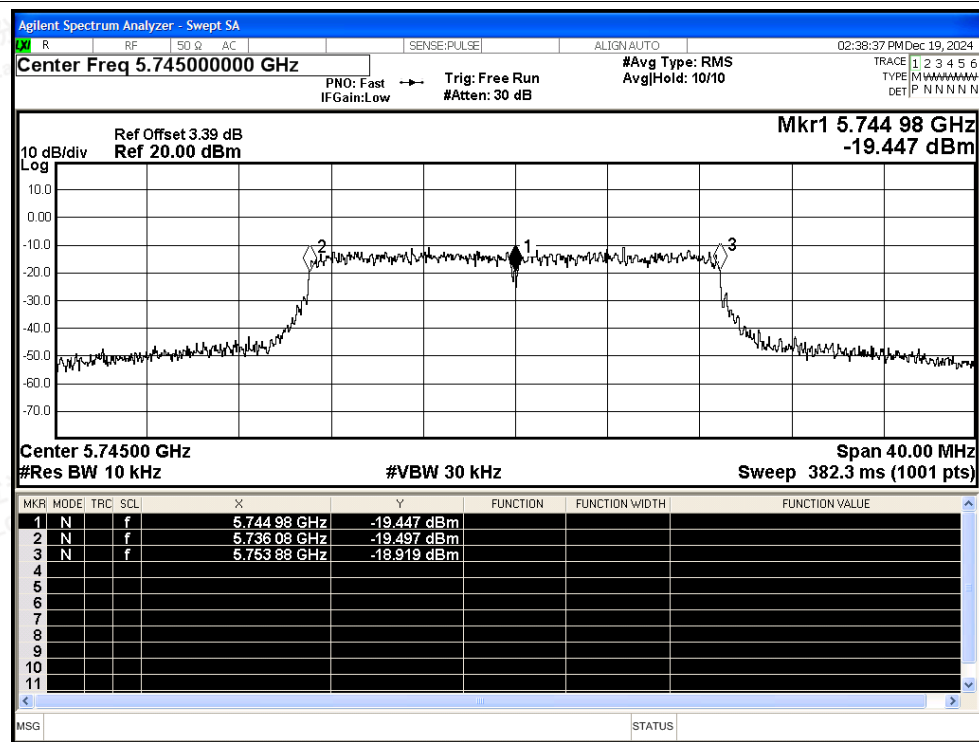

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant2

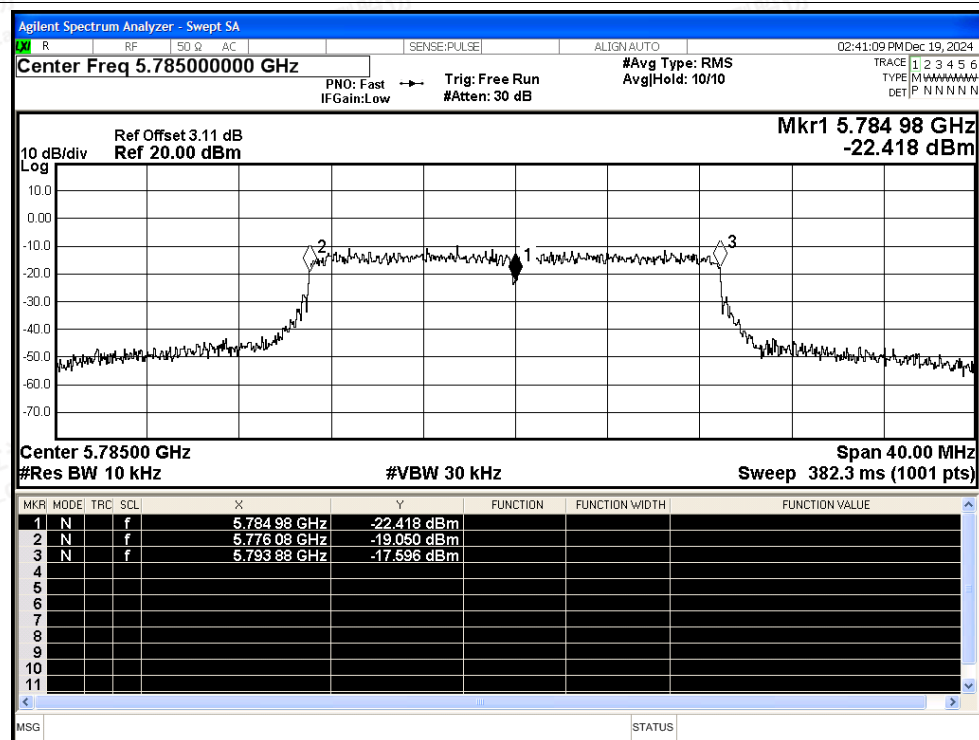

Freq. Stability NVNT n20 5825MHz Ant2

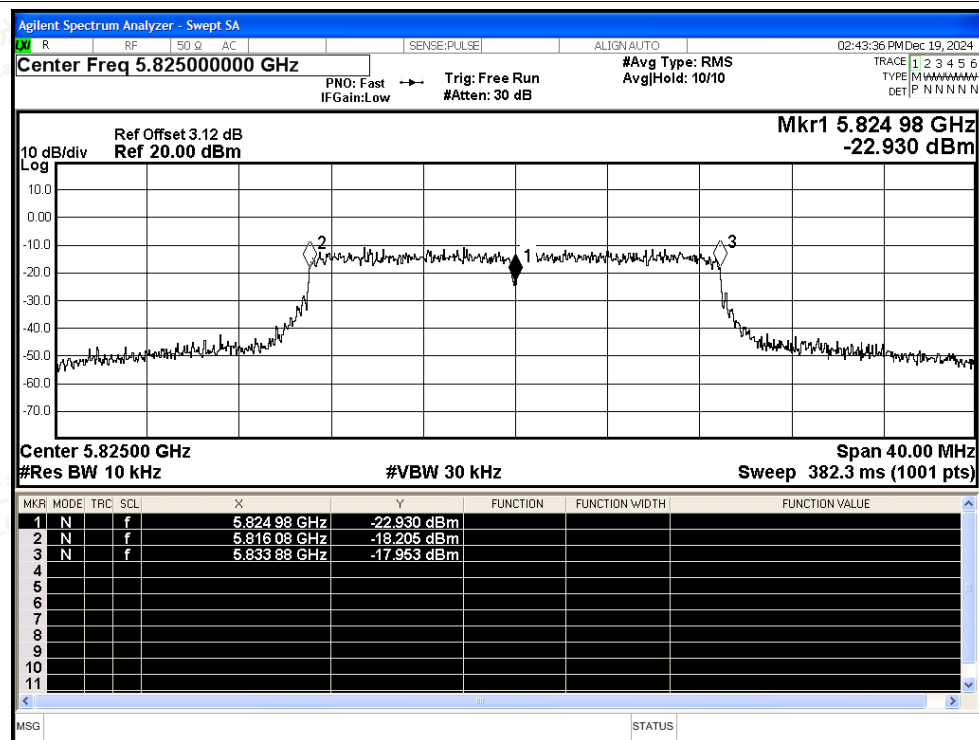

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant2

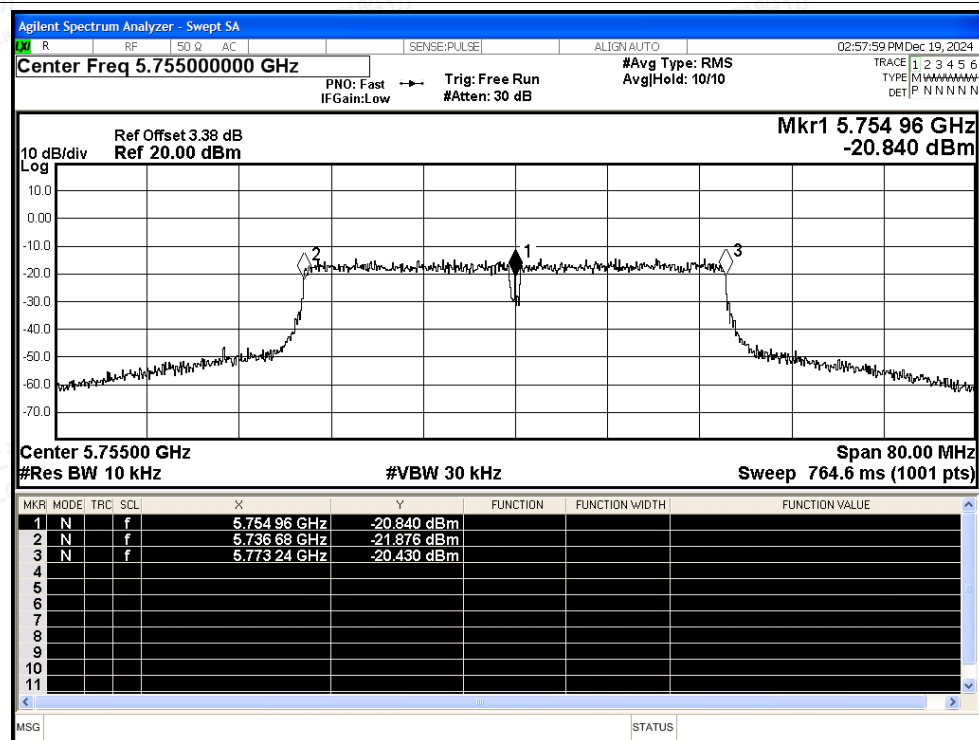

Freq. Stability NVNT n40 5795MHz Ant2

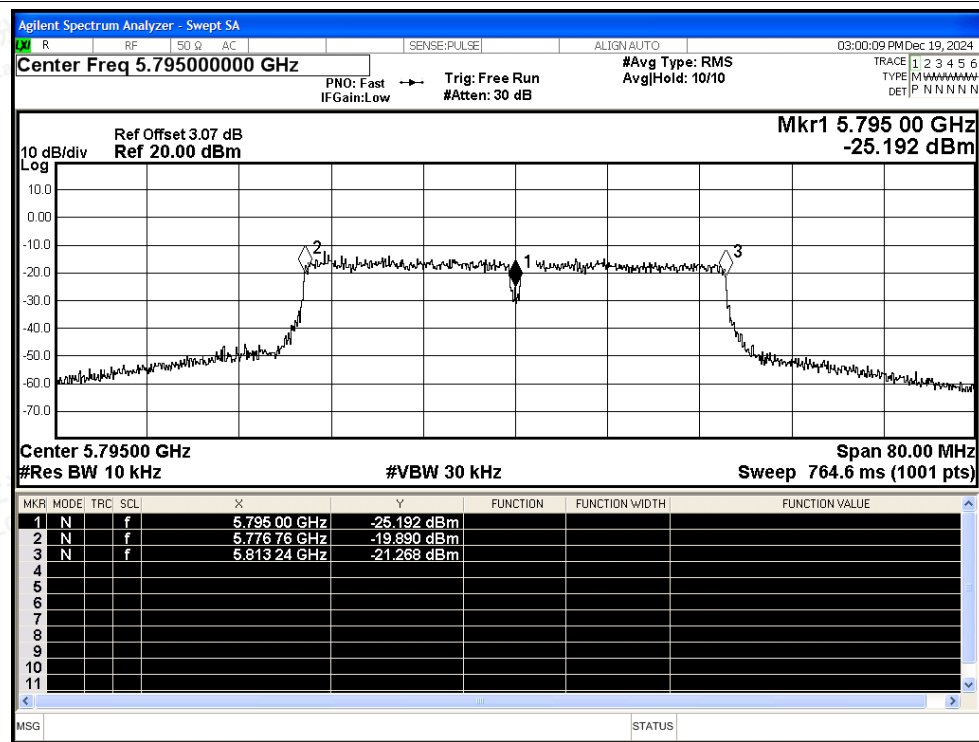

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant2

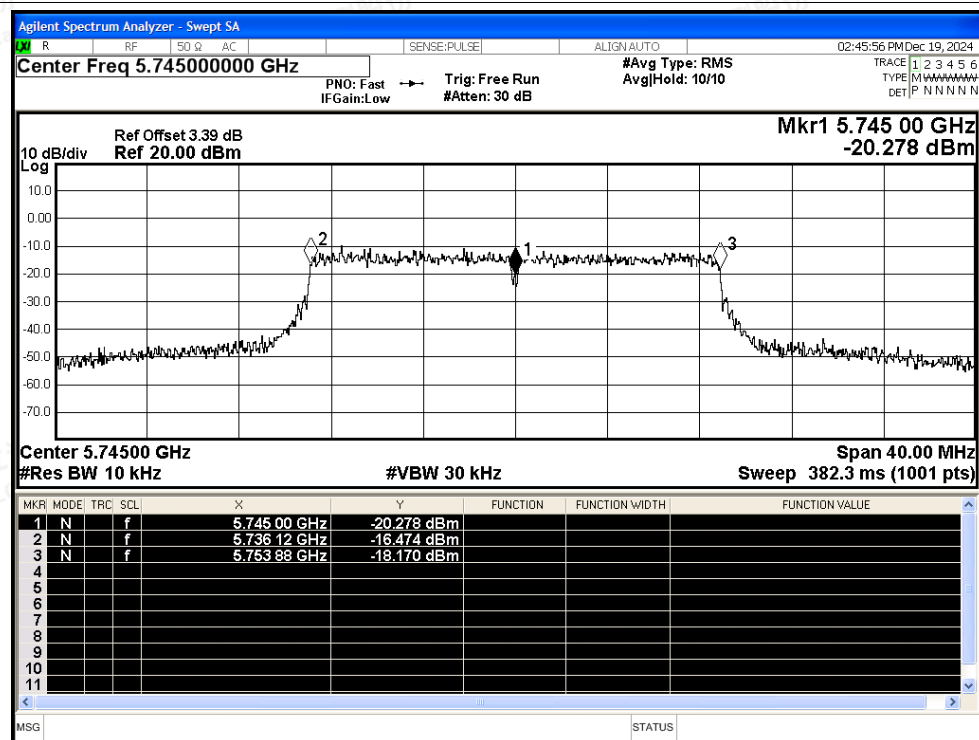

Freq. Stability NVNT ac20 5785MHz Ant2

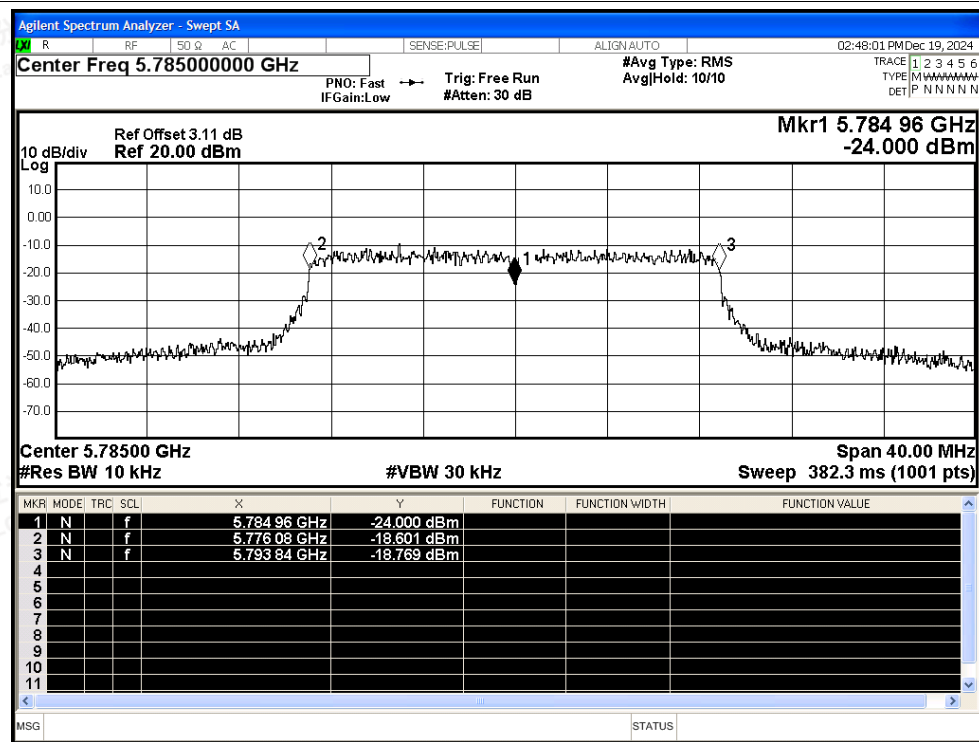

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant2

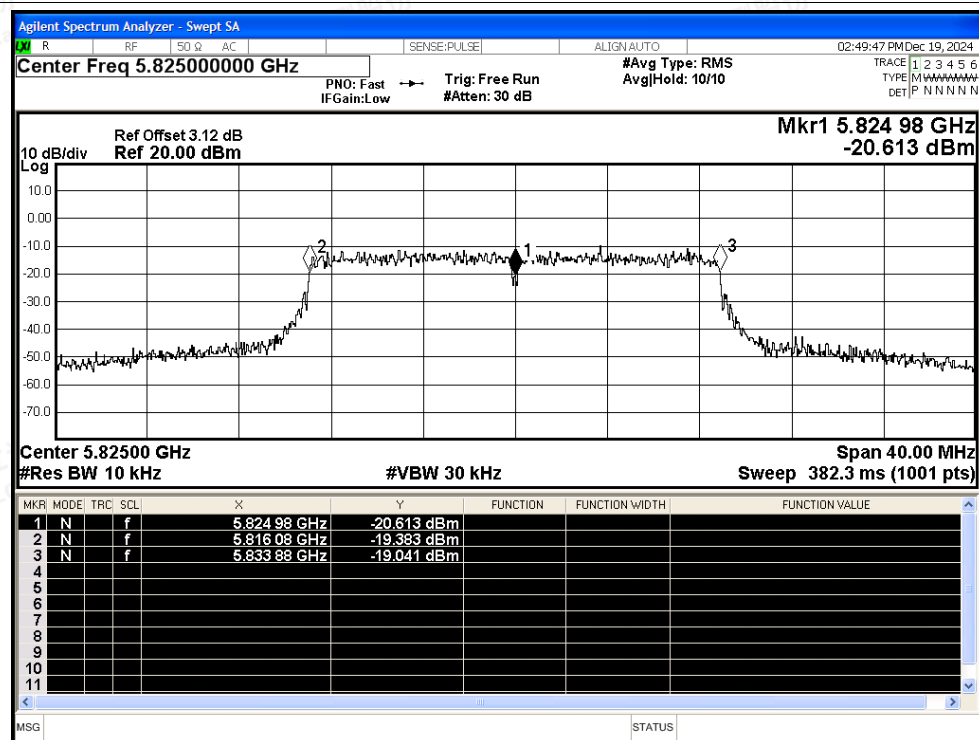

Freq. Stability NVNT ac40 5755MHz Ant2

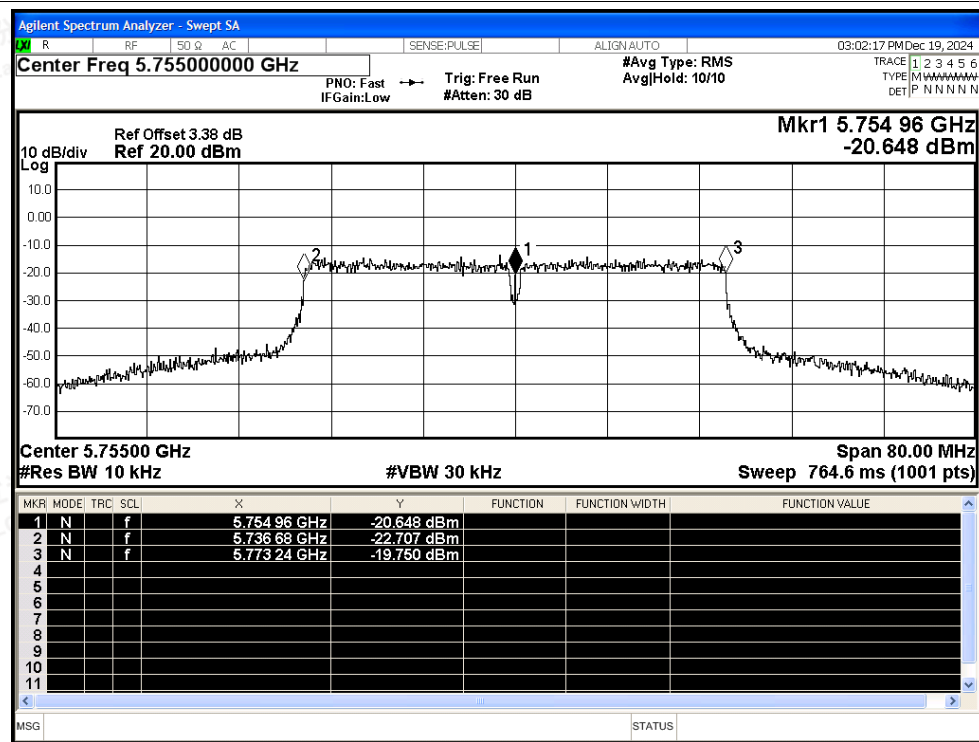

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant2

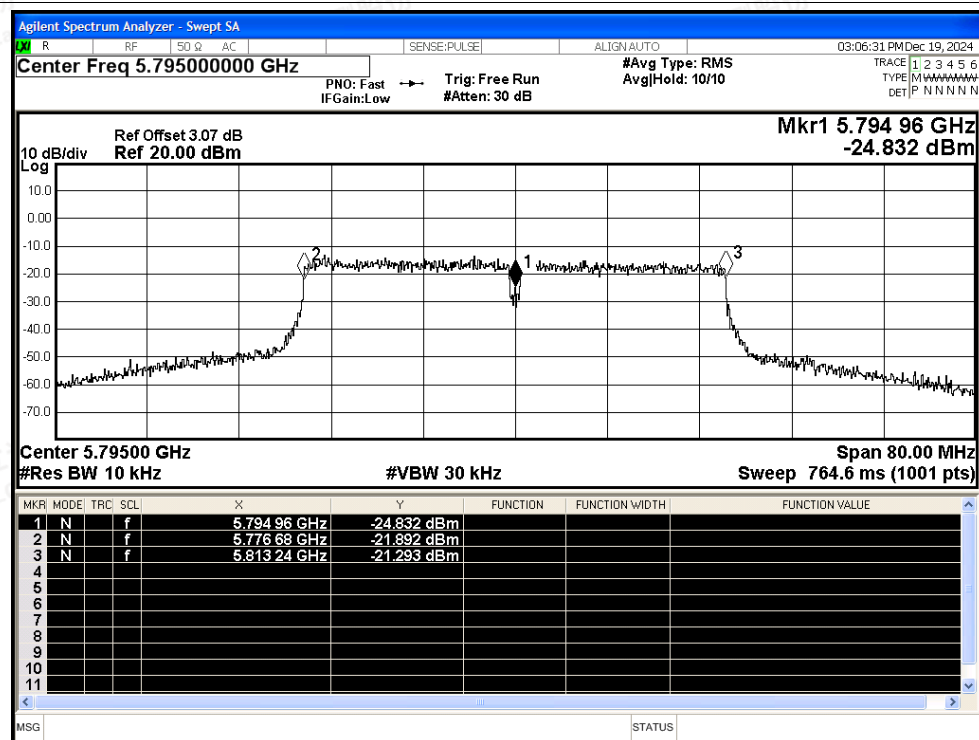

Freq. Stability NVNT ac80 5775MHz Ant2

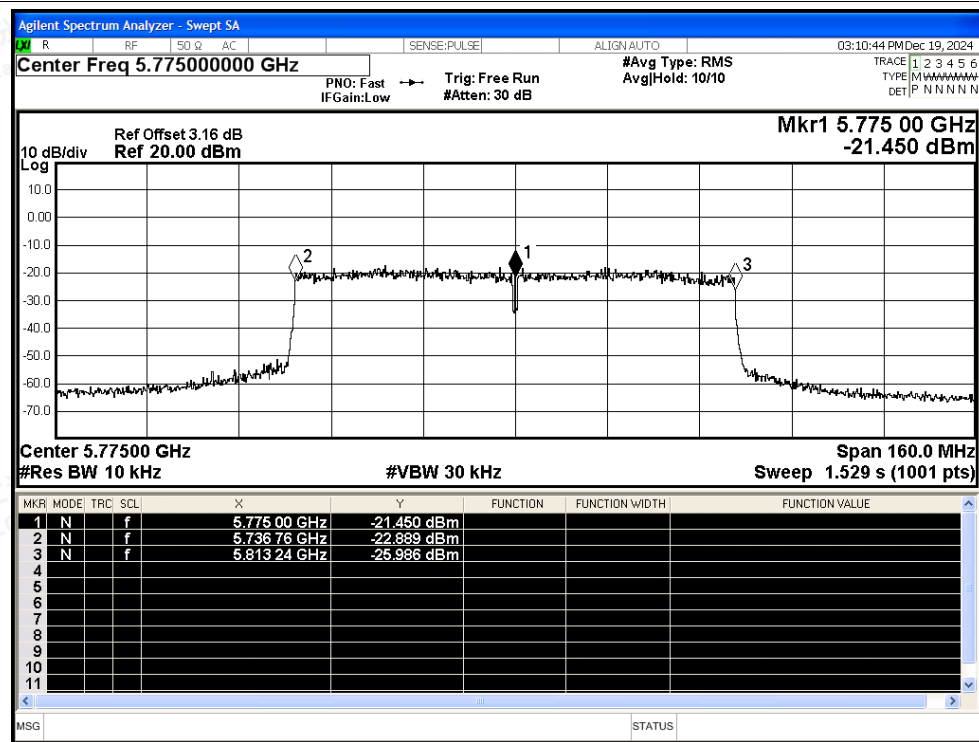

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant2

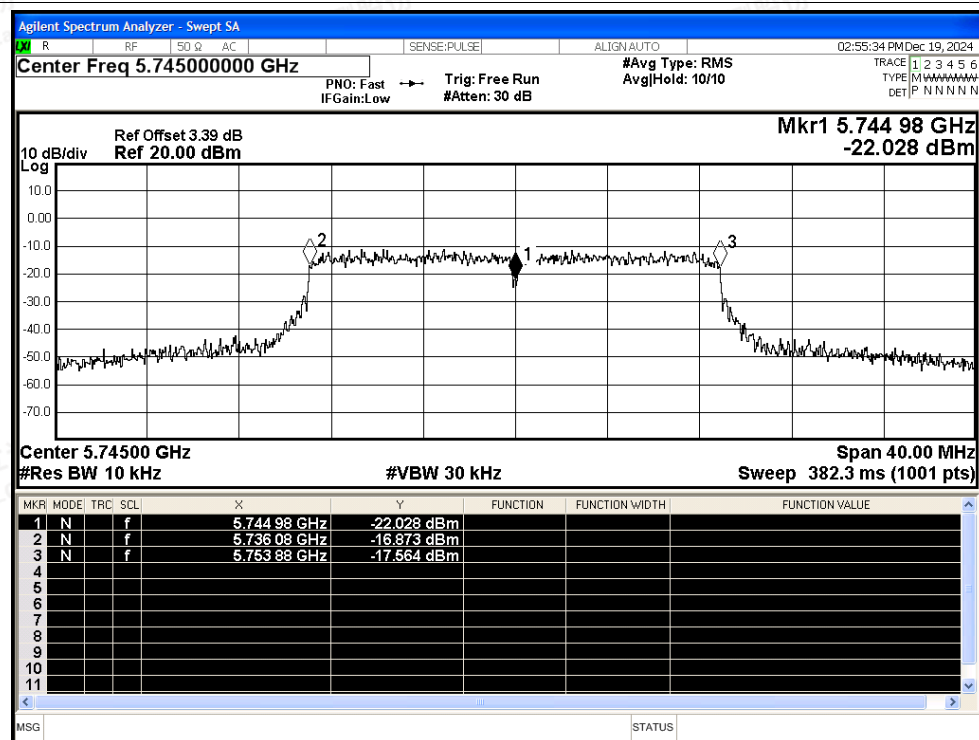

Freq. Stability NVNT ax20 5785MHz Ant2

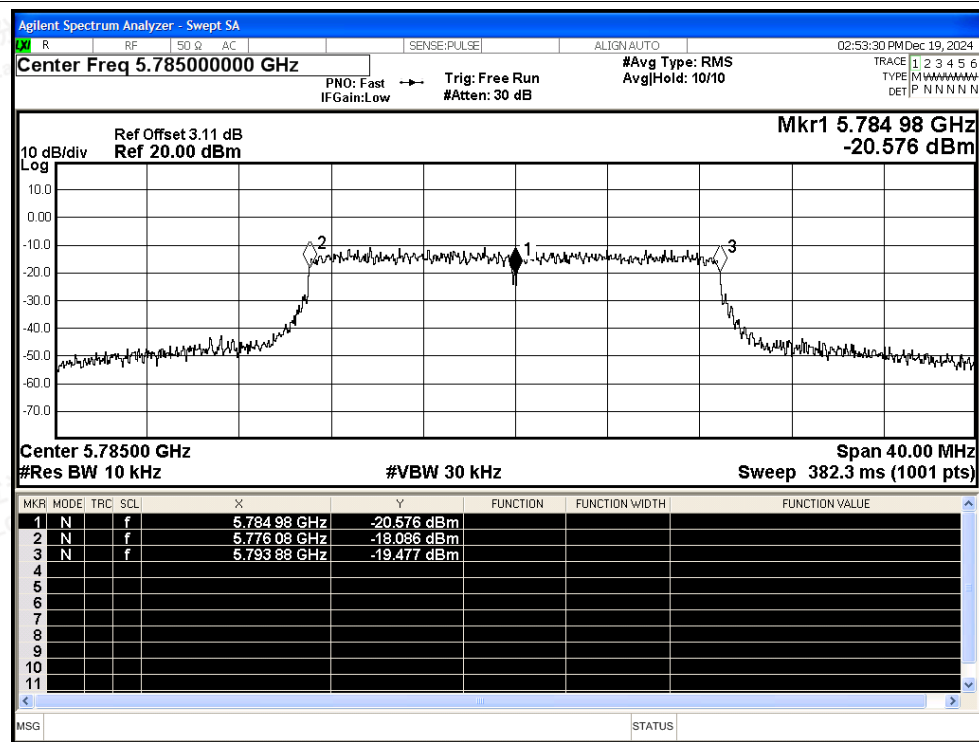

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity