


Appendix A: Transmitting burst length

Worst Test Result


TestMode	Antenna	Channel	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Limit (ms)
11A	Ant1	5180	1.42	1.57	90.45	8 or less
	Ant2	5180	1.42	1.57	90.45	8 or less
	Ant1	5200	1.42	1.57	90.45	8 or less
	Ant2	5200	1.42	1.57	90.45	8 or less
	Ant1	5240	1.42	1.57	90.45	8 or less
	Ant2	5240	1.42	1.57	90.45	8 or less
11N20SISO	Ant1	5180	1.33	1.48	89.86	8 or less
	Ant2	5180	1.33	1.48	89.86	8 or less
	Ant1	5200	1.33	1.48	89.86	8 or less
	Ant2	5200	1.33	1.48	89.86	8 or less
	Ant1	5240	1.33	1.48	89.86	8 or less
	Ant2	5240	1.33	1.48	89.86	8 or less
11N40SISO	Ant1	5190	0.66	0.81	81.48	8 or less
	Ant2	5190	0.66	0.81	81.48	8 or less
	Ant1	5230	0.66	0.81	81.48	8 or less
	Ant2	5230	0.66	0.81	81.48	8 or less
11AC20SISO	Ant1	5180	1.33	1.48	89.86	8 or less
	Ant2	5180	1.33	1.48	89.86	8 or less
	Ant1	5200	1.33	1.48	89.86	8 or less
	Ant2	5200	1.33	1.48	89.86	8 or less
	Ant1	5240	1.33	1.48	89.86	8 or less
	Ant2	5240	1.33	1.48	89.86	8 or less
11AC40SISO	Ant1	5190	0.66	0.81	81.48	8 or less
	Ant2	5190	0.66	0.81	81.48	8 or less
	Ant1	5230	0.66	0.81	81.48	8 or less
	Ant2	5230	0.66	0.81	81.48	8 or less
11AC80SISO	Ant1	5210	0.33	0.48	68.75	8 or less
	Ant2	5210	0.33	0.48	68.75	8 or less
11AX20SISO	Ant1	5180	1.04	1.19	87.39	8 or less
	Ant2	5180	1.04	1.19	87.39	8 or less
	Ant1	5200	1.04	1.19	87.39	8 or less
	Ant2	5200	1.04	1.19	87.39	8 or less
	Ant1	5240	1.04	1.19	87.39	8 or less
	Ant2	5240	1.04	1.19	87.39	8 or less
11AX40SISO	Ant1	5190	0.55	0.70	78.57	8 or less
	Ant2	5190	0.54	0.70	77.14	8 or less
	Ant1	5230	0.55	0.70	78.57	8 or less
	Ant2	5230	0.55	0.70	78.57	8 or less
11AX80SISO	Ant1	5210	0.29	0.44	65.91	8 or less
	Ant2	5210	0.29	0.44	65.91	8 or less

Test Graphs

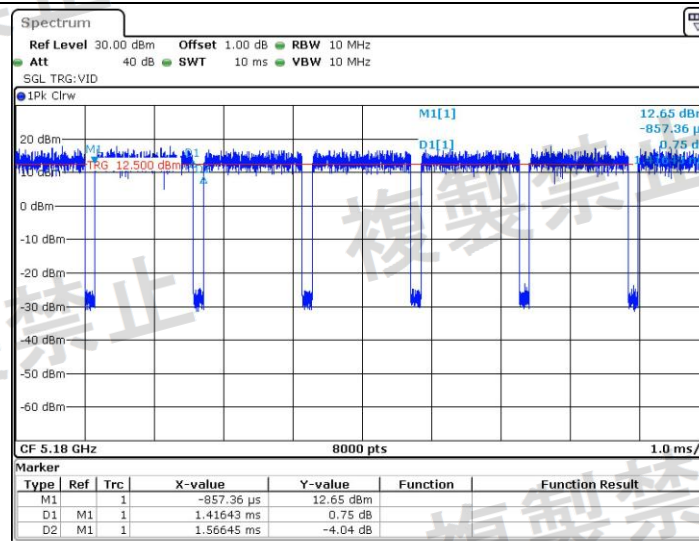


Date: 17.OCT.2025 16:35:00

11A_Ant1_5180

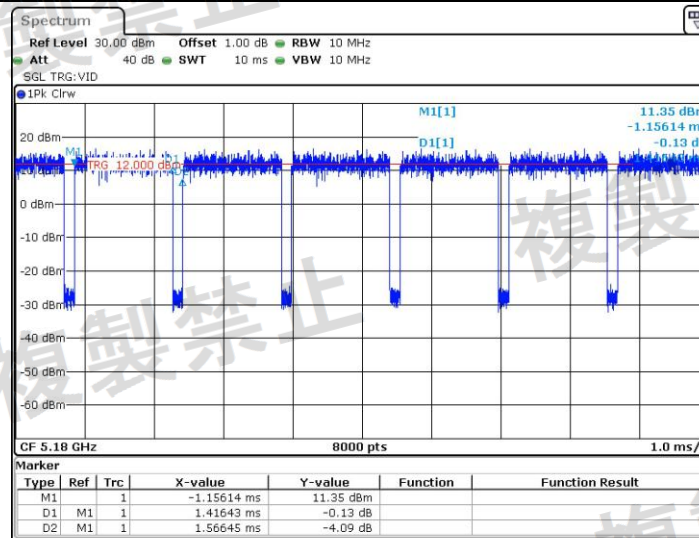


Date: 17.OCT.2025 16:52:51

11A_Ant2_5180

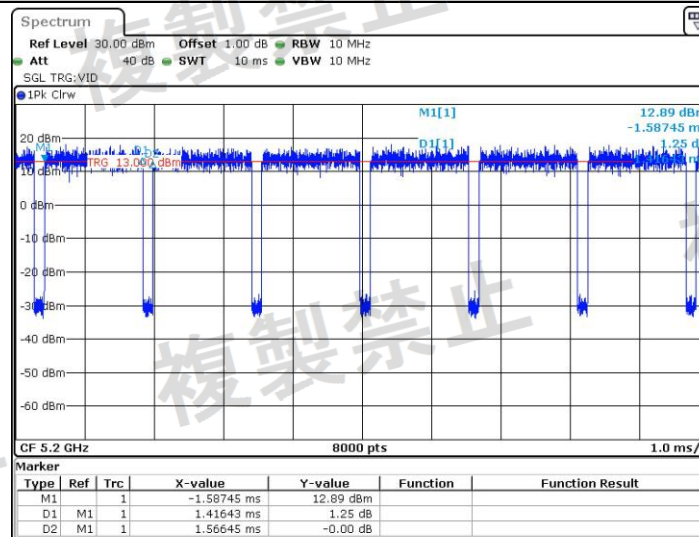


Date: 17.OCT.2025 16:35:31


11A_Ant1_5200

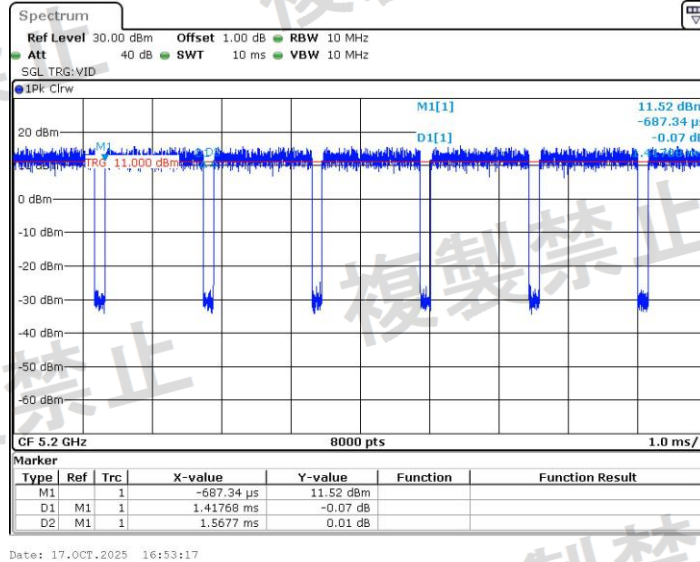


11A_Ant2_5200

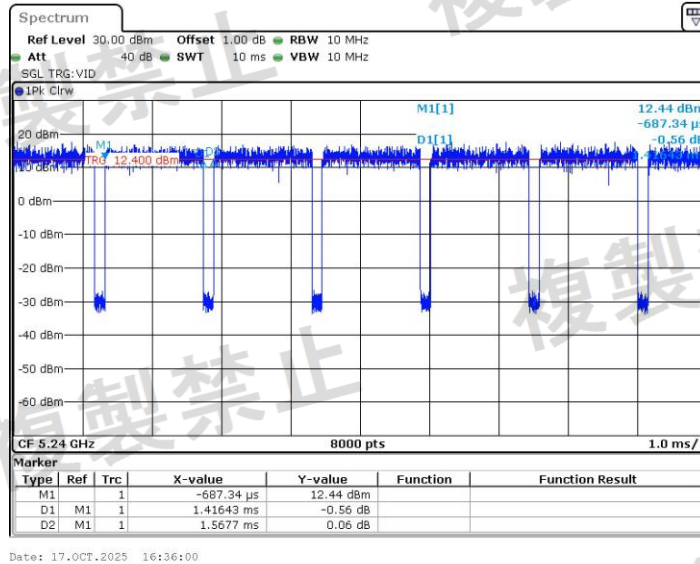

11A_Ant1_5240

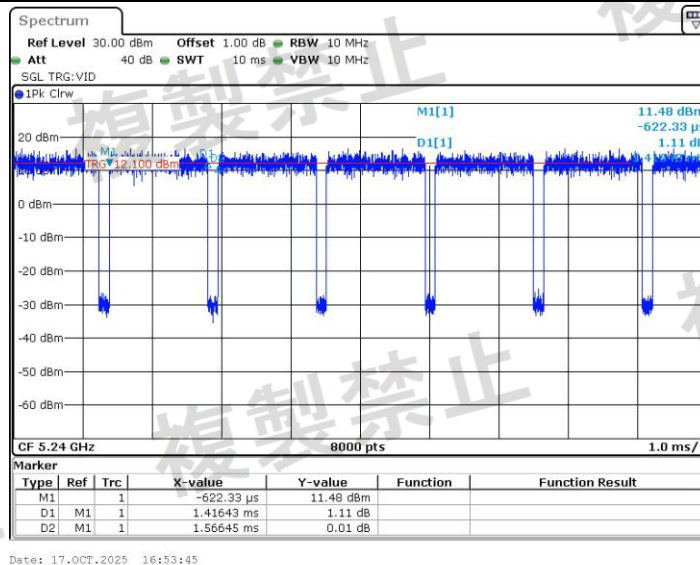


11A_Ant2_5240

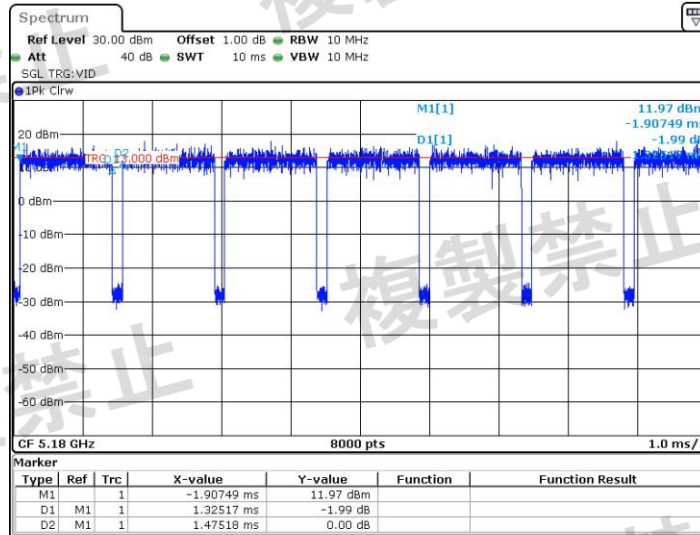


Date: 17.OCT.2025 16:36:49

11N20ISO_Ant1_5180

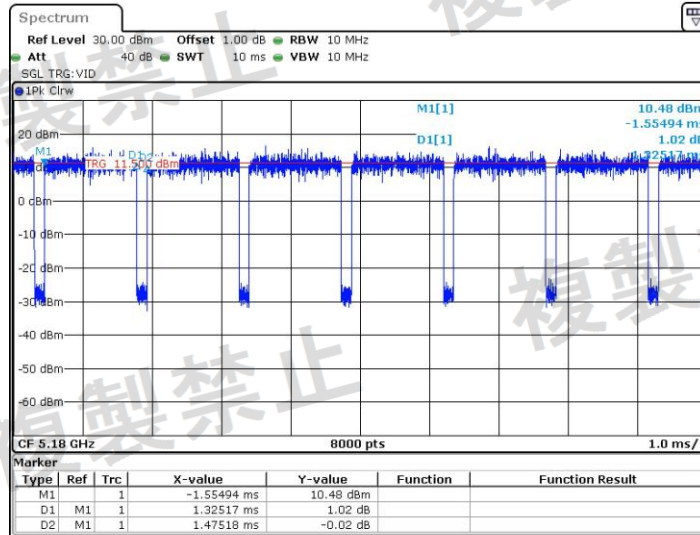


Date: 17.OCT.2025 16:54:28

11N20ISO_Ant2_5180

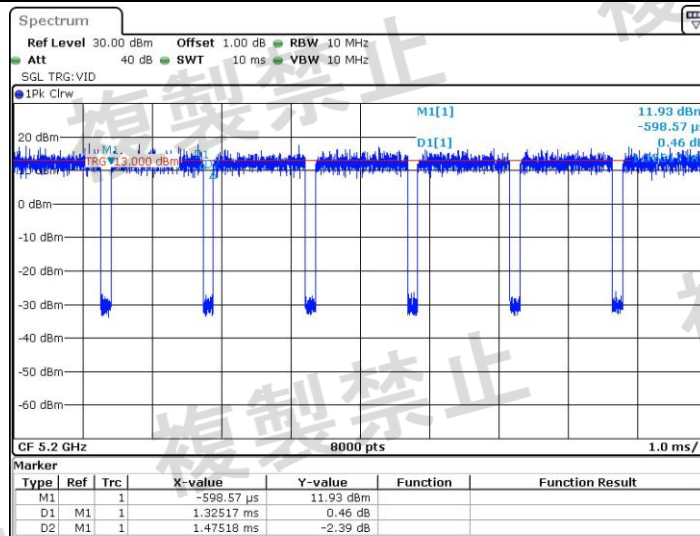


Date: 17.OCT.2025 16:37:52

11N20ISO_Ant1_5200

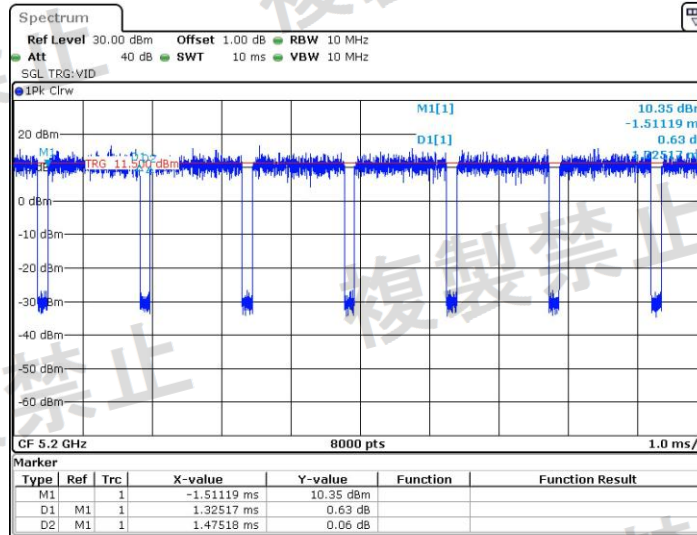


Date: 17.OCT.2025 16:54:55

11N20SISO_Ant2_5200

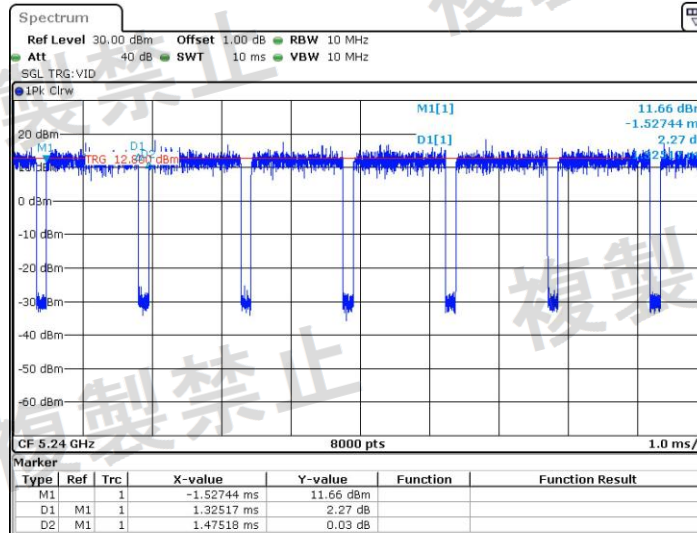


Date: 17.OCT.2025 16:38:23

11N20SISO_Ant1_5240

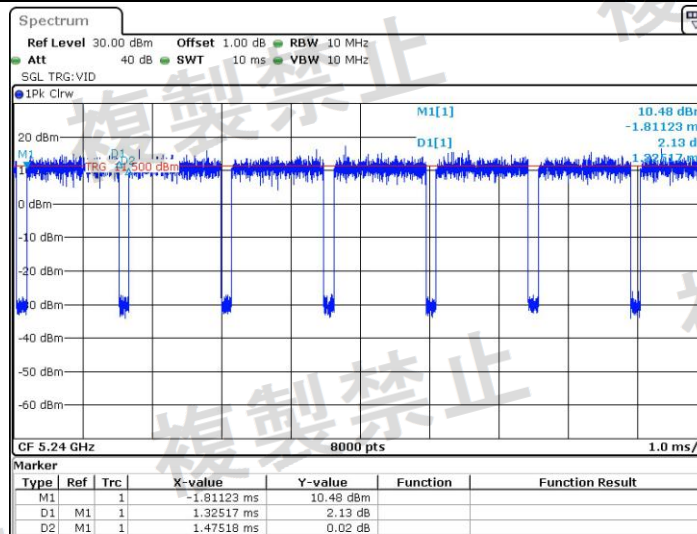


Date: 17.OCT.2025 16:55:24


11N20SISO_Ant2_5240

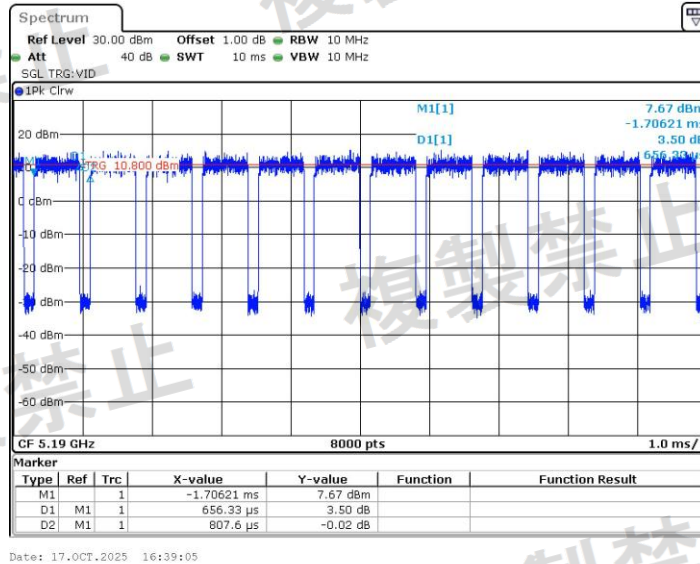


11N40ISO_Ant1_5190

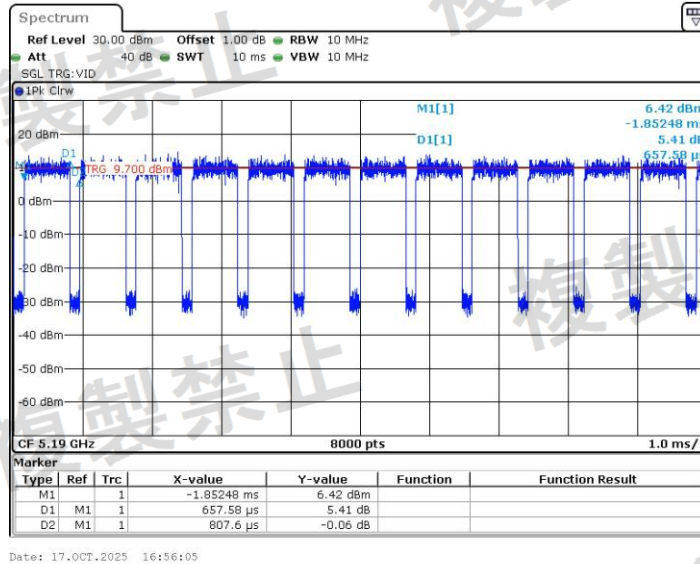


11N40ISO_Ant2_5190

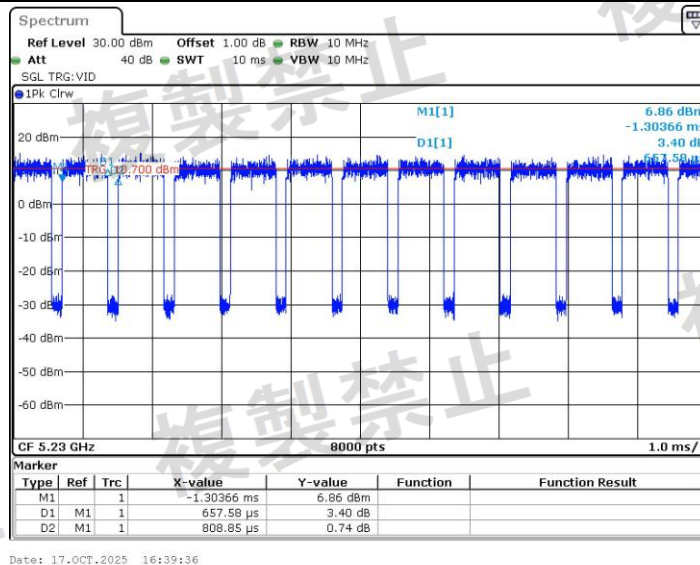


11N40ISO_Ant1_5230

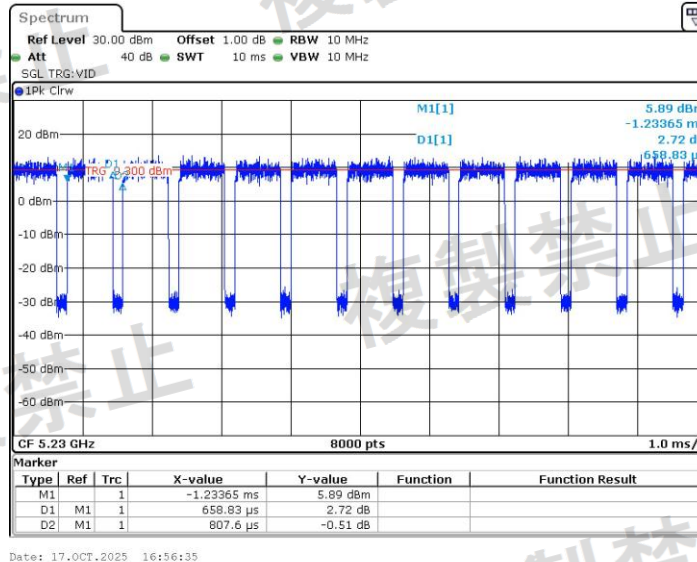


11N40SISO_Ant2_5230

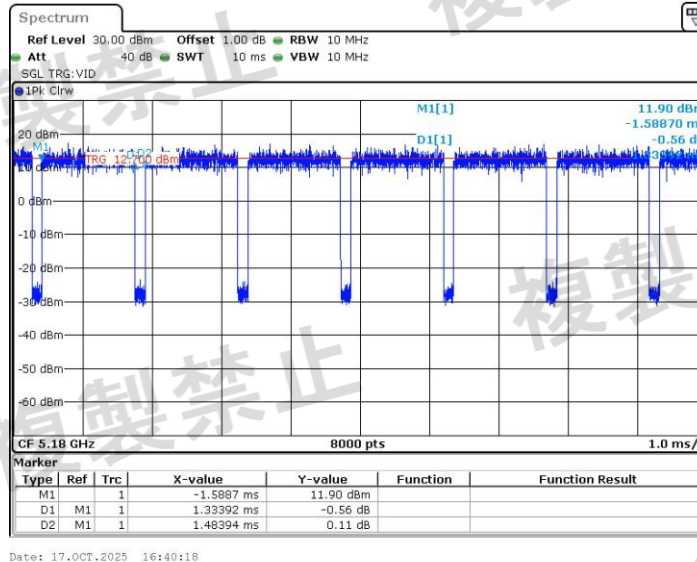


11AC20SISO_Ant1_5180

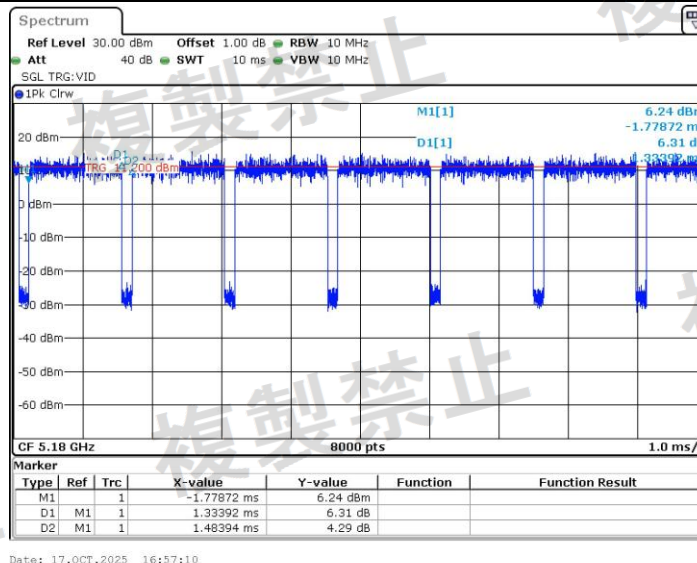


11AC20SISO_Ant2_5180

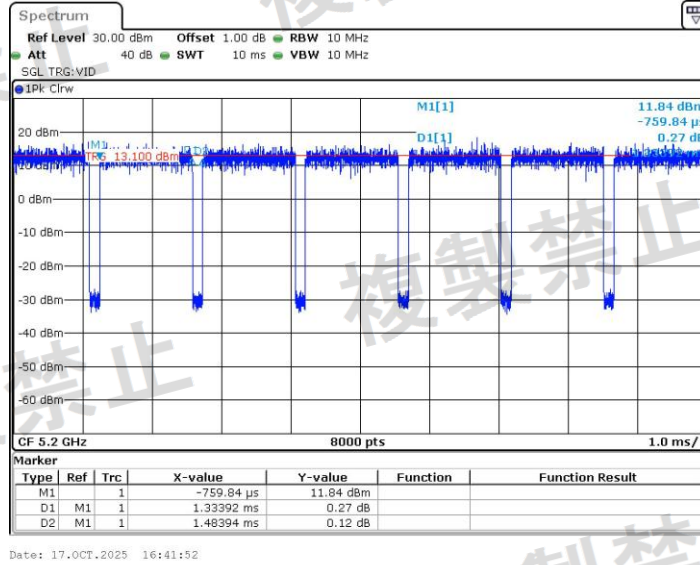


11AC20SISO_Ant1_5200

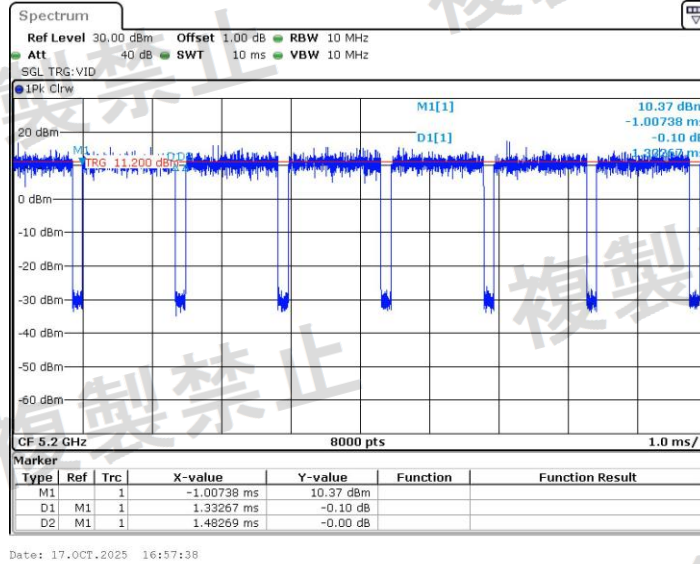

11AC20SISO_Ant2_5200

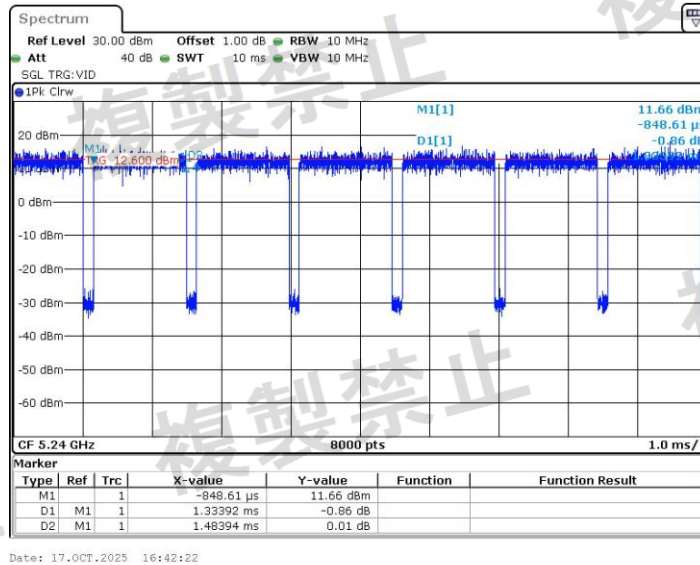


11AC20SISO_Ant1_5240

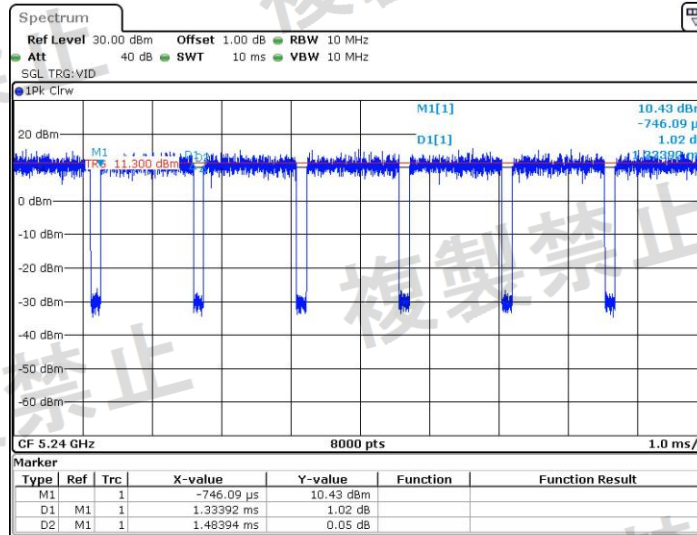


Date: 17.OCT.2025 16:58:06

11AC20SISO_Ant2_5240

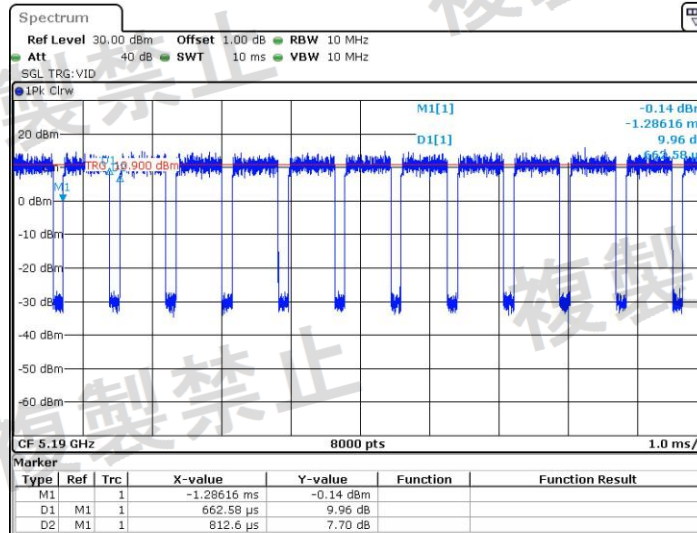


Date: 17.OCT.2025 16:43:08

11AC40SISO_Ant1_5190

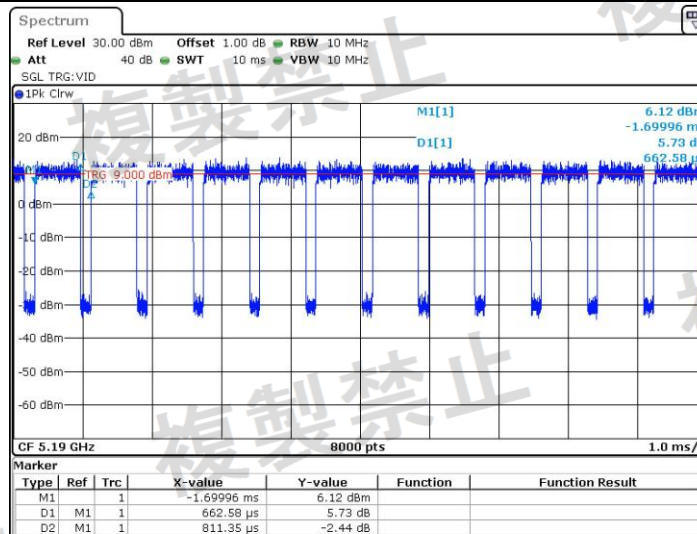


Date: 17.OCT.2025 16:58:45


11AC40SISO_Ant2_5190

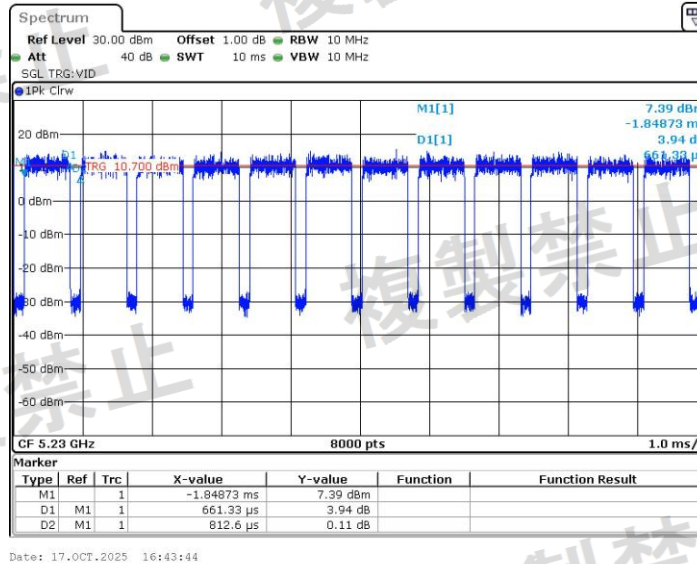


11AC40SISO_Ant1_5230

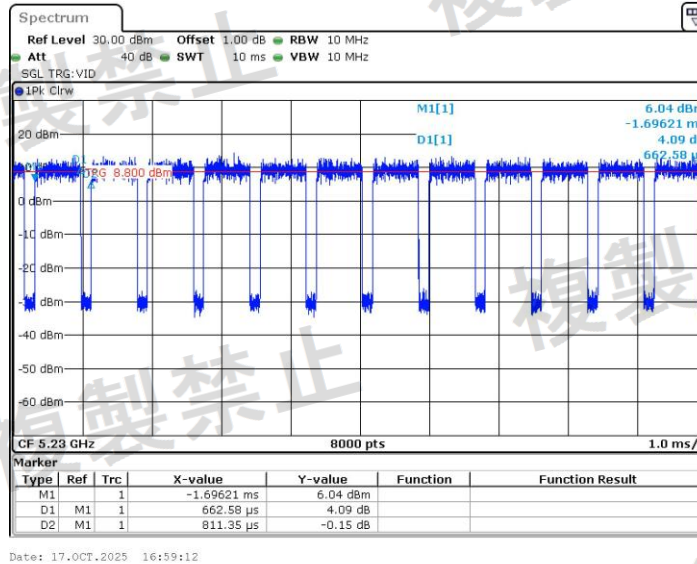

11AC40SISO_Ant2_5230

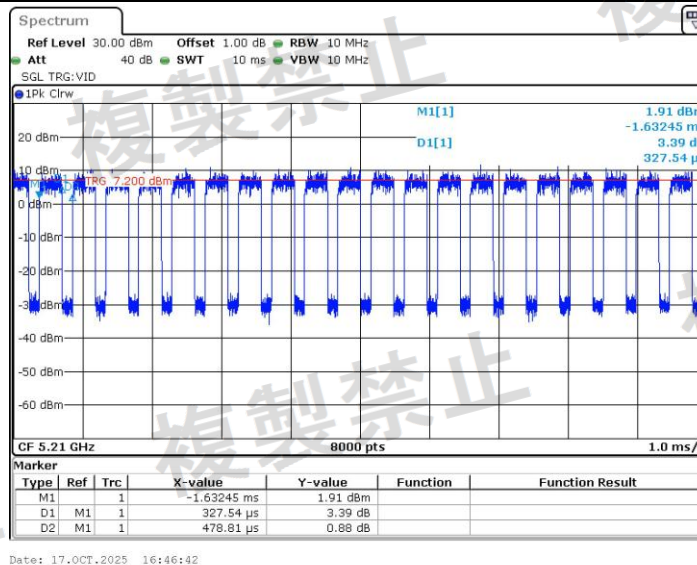


11AC80SISO_Ant1_5210

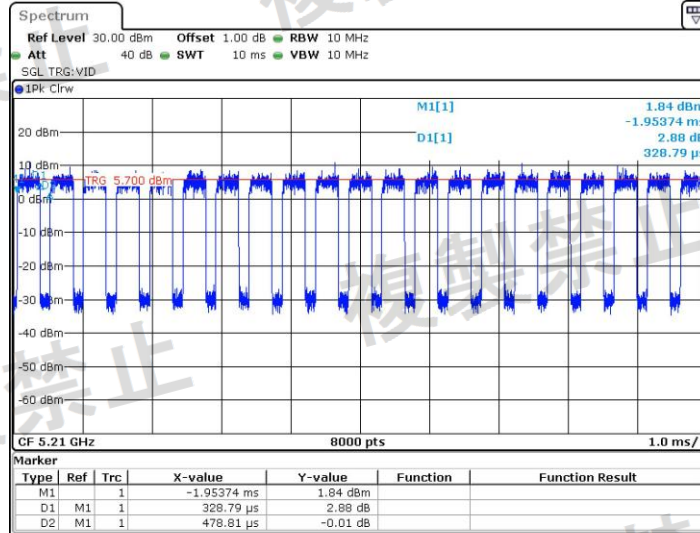


Date: 17.OCT.2025 17:00:04

11AC80SISO_Ant2_5210

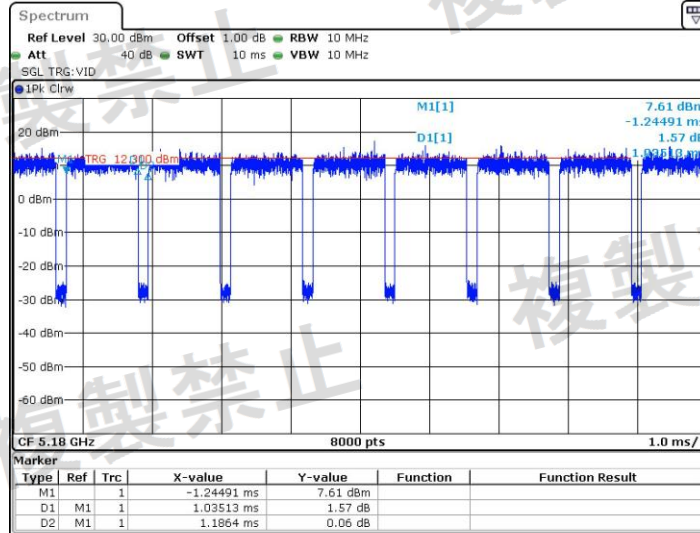


Date: 17.OCT.2025 16:47:41

11AX20SISO_Ant1_5180

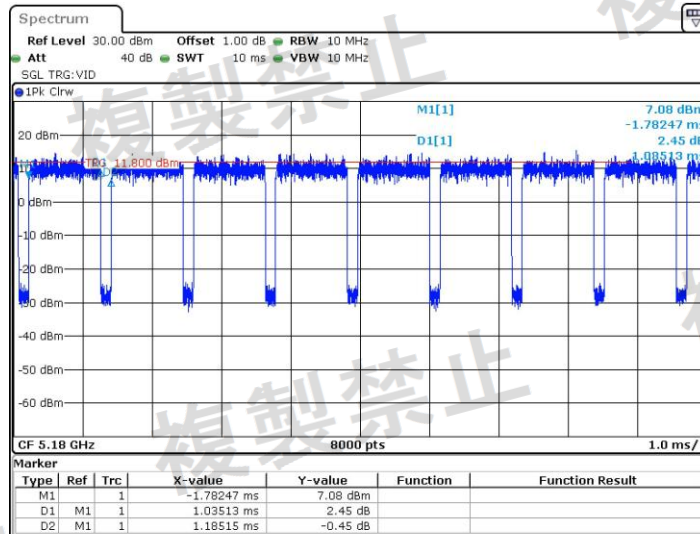


Date: 17.OCT.2025 17:00:36

11AX20SISO_Ant2_5180

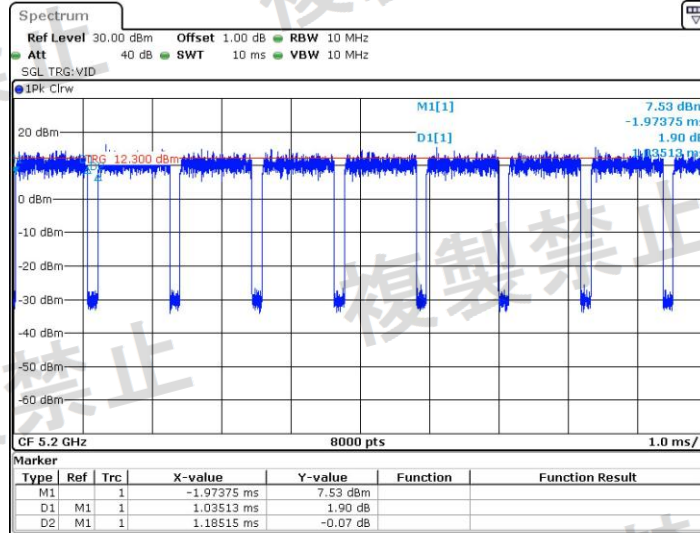


Date: 17.OCT.2025 16:48:11

11AX20SISO_Ant1_5200

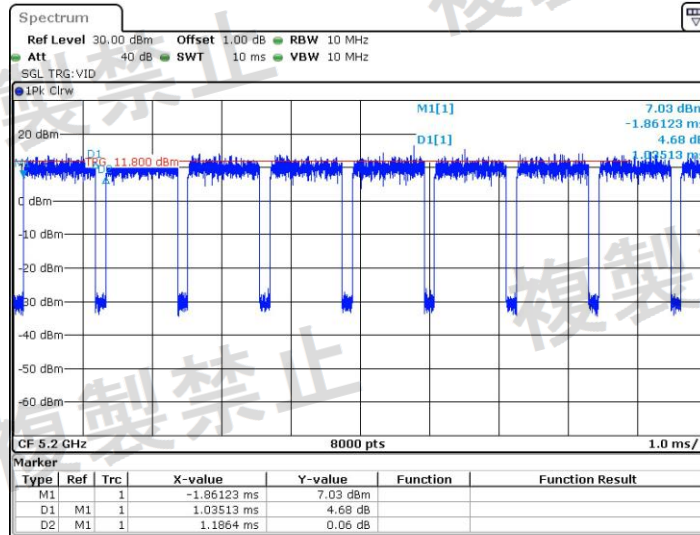

Date: 17.OCT.2025 17:01:04

11AX20SISO_Ant2_5200

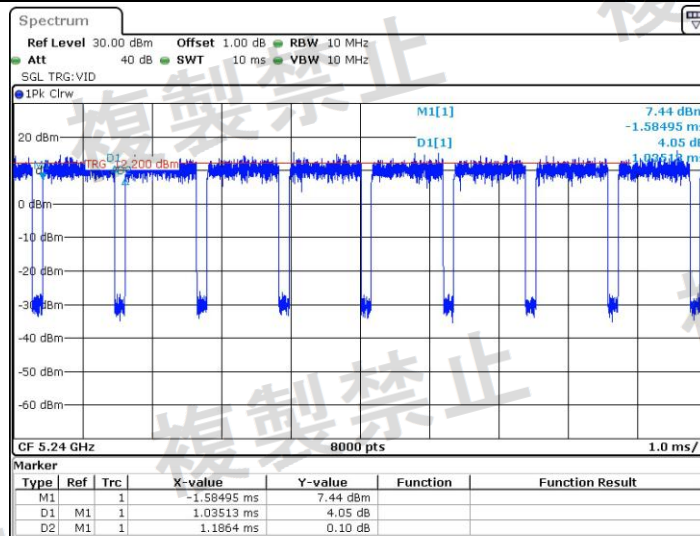


Date: 17.OCT.2025 16:48:40

11AX20SISO_Ant1_5240




Date: 17.OCT.2025 17:01:32

11AX20SISO_Ant2_5240

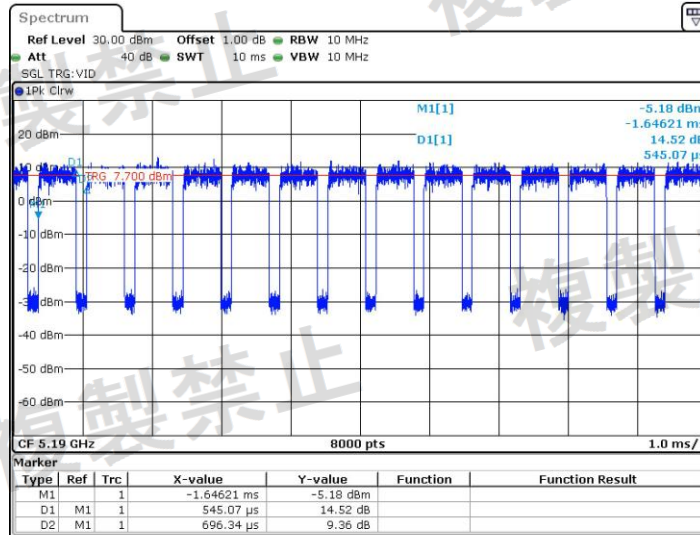


Date: 17.OCT.2025 16:49:24

11AX40SISO_Ant1_5190

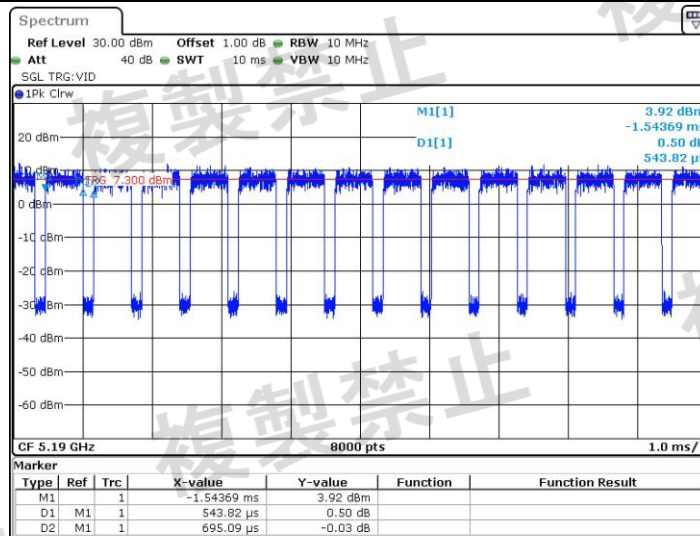


Date: 17.OCT.2025 17:02:05

11AX40SISO_Ant2_5190

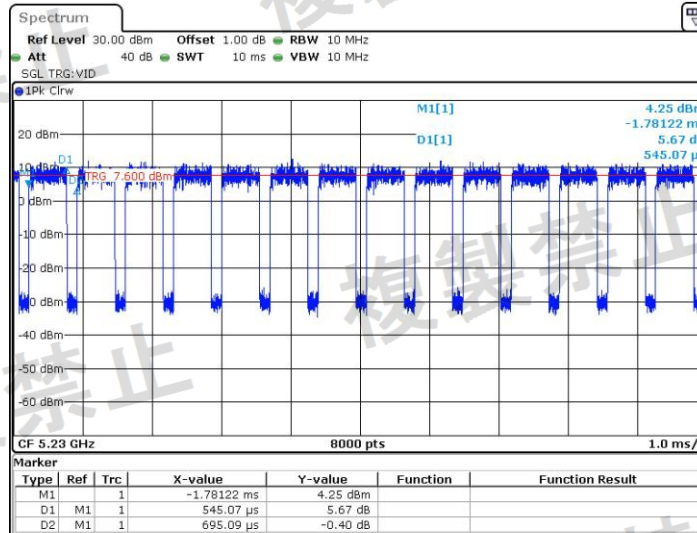


Date: 17.OCT.2025 16:49:55

11AX40SISO_Ant1_5230

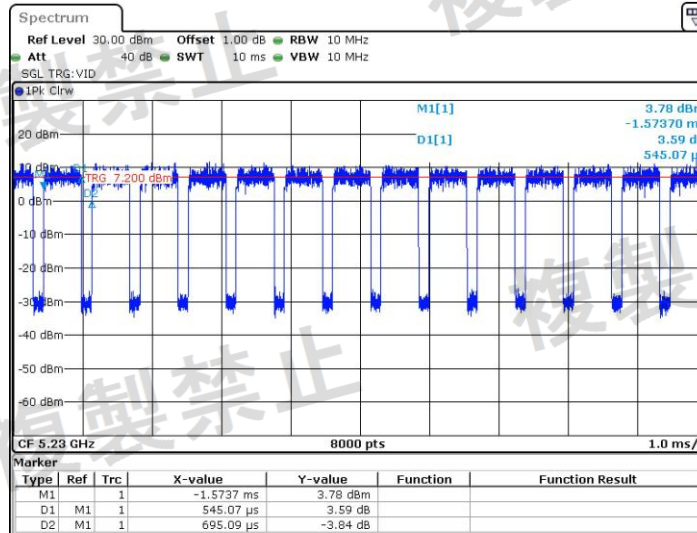


Date: 17.OCT.2025 17:02:34

11AX40SISO_Ant2_5230

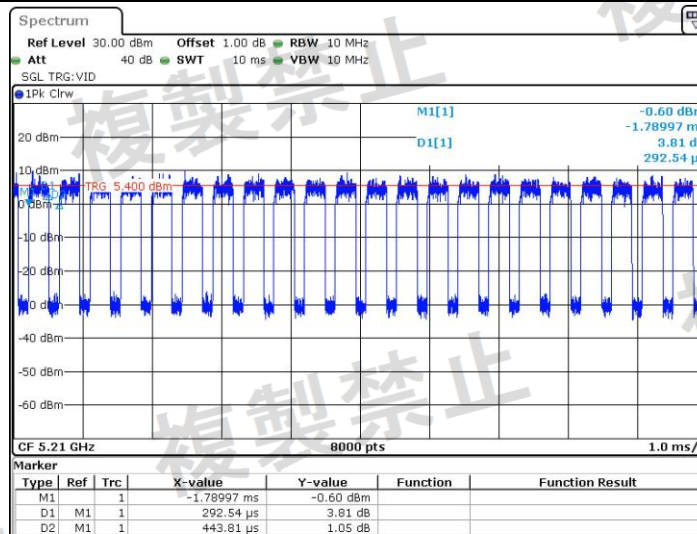

Date: 17.OCT.2025 16:50:37

11AX80SISO_Ant1_5210

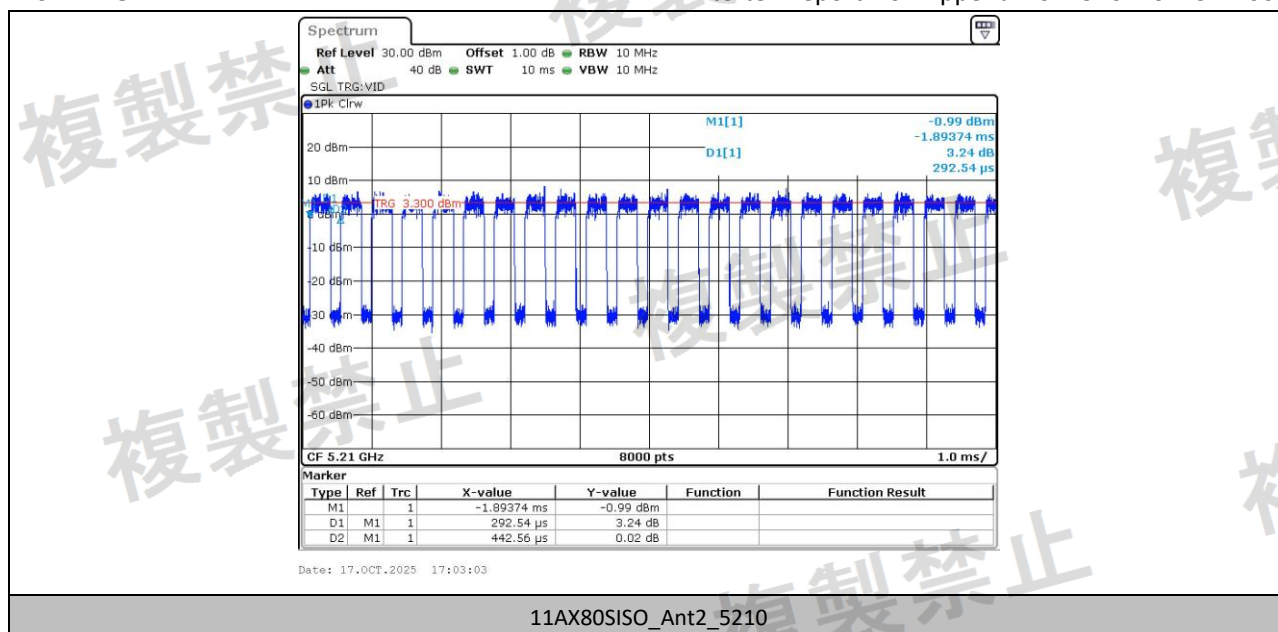


Appendix B: Occupied channel bandwidth

Worst Test Result


TestMode	Antenna	Channel	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.424	5171.768	5188.192	20 or less	PASS
	Ant2	5180	16.503	5171.728	5188.232	20 or less	PASS
	Ant1	5200	16.503	5191.728	5208.232	20 or less	PASS
	Ant2	5200	16.424	5191.728	5208.152	20 or less	PASS
	Ant1	5240	16.743	5231.608	5248.352	20 or less	PASS
	Ant2	5240	16.543	5231.728	5248.272	20 or less	PASS
11N20SISO	Ant1	5180	17.622	5171.209	5188.831	20 or less	PASS
	Ant2	5180	17.542	5171.209	5188.751	20 or less	PASS
	Ant1	5200	17.742	5191.049	5208.791	20 or less	PASS
	Ant2	5200	17.622	5191.169	5208.791	20 or less	PASS
	Ant1	5240	17.822	5231.129	5248.951	20 or less	PASS
	Ant2	5240	17.582	5231.209	5248.791	20 or less	PASS
11N40SISO	Ant1	5190	36.204	5171.938	5208.142	40 or less	PASS
	Ant2	5190	36.204	5171.938	5208.142	40 or less	PASS
	Ant1	5230	36.204	5211.938	5248.142	40 or less	PASS
	Ant2	5230	36.204	5211.938	5248.142	40 or less	PASS
11AC20SISO	Ant1	5180	17.622	5171.209	5188.831	20 or less	PASS
	Ant2	5180	17.582	5171.169	5188.751	20 or less	PASS
	Ant1	5200	17.782	5191.209	5208.991	20 or less	PASS
	Ant2	5200	17.822	5191.129	5208.951	20 or less	PASS
	Ant1	5240	17.862	5231.129	5248.991	20 or less	PASS
	Ant2	5240	17.622	5231.169	5248.791	20 or less	PASS
11AC40SISO	Ant1	5190	36.204	5171.938	5208.142	40 or less	PASS
	Ant2	5190	36.204	5171.938	5208.142	40 or less	PASS
	Ant1	5230	36.204	5211.938	5248.142	40 or less	PASS
	Ant2	5230	36.204	5211.938	5248.142	40 or less	PASS
11AC80SISO	Ant1	5210	75.764	5172.118	5247.882	80 or less	PASS
	Ant2	5210	75.604	5172.118	5247.722	80 or less	PASS
11AX20SISO	Ant1	5180	18.861	5170.569	5189.431	20 or less	PASS
	Ant2	5180	18.941	5170.529	5189.471	20 or less	PASS
	Ant1	5200	19.061	5190.450	5209.510	20 or less	PASS
	Ant2	5200	18.941	5190.529	5209.471	20 or less	PASS
	Ant1	5240	18.981	5230.529	5249.510	20 or less	PASS
	Ant2	5240	18.981	5230.529	5249.510	20 or less	PASS
11AX40SISO	Ant1	5190	37.562	5171.299	5208.861	40 or less	PASS
	Ant2	5190	37.642	5171.219	5208.861	40 or less	PASS
	Ant1	5230	37.562	5211.299	5248.861	40 or less	PASS
	Ant2	5230	37.562	5211.299	5248.861	40 or less	PASS
11AX80SISO	Ant1	5210	77.043	5171.479	5248.521	80 or less	PASS
	Ant2	5210	76.883	5171.638	5248.521	80 or less	PASS

Test Graphs

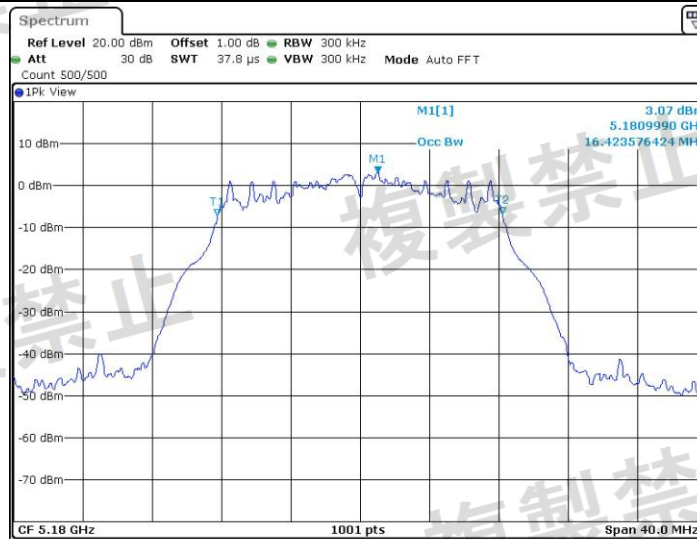

Date: 17.OCT.2025 16:34:49

11A_Ant1_5180

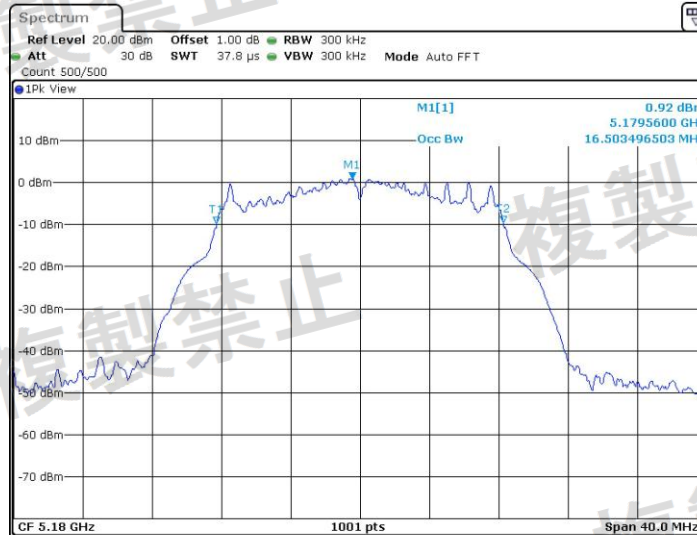


Date: 17.OCT.2025 16:52:39

11A_Ant2_5180




Date: 17.OCT.2025 16:35:22


11A_Ant1_5200

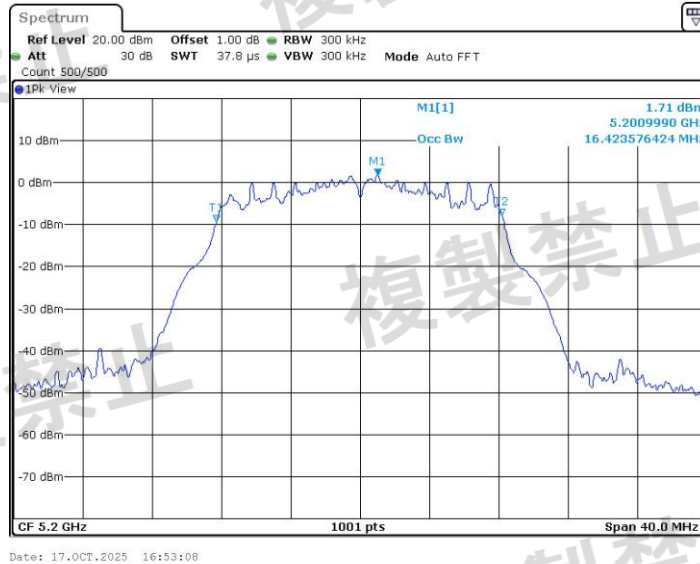


11A_Ant2_5200

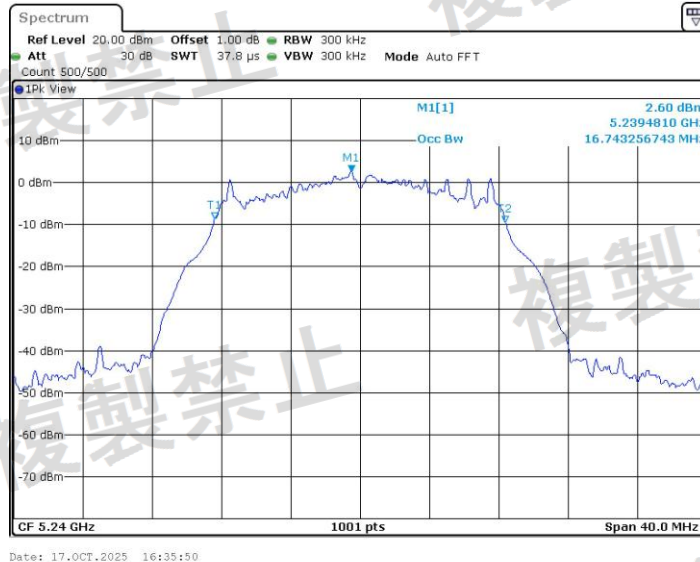


11A_Ant1_5240

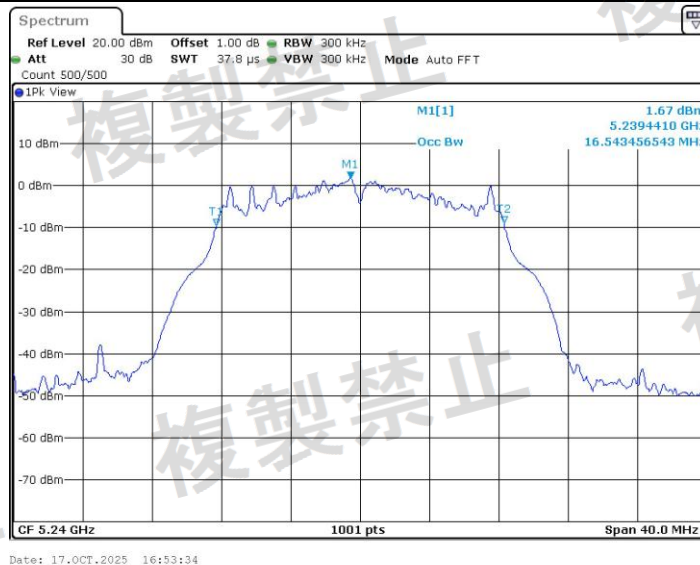


11A_Ant2_5240

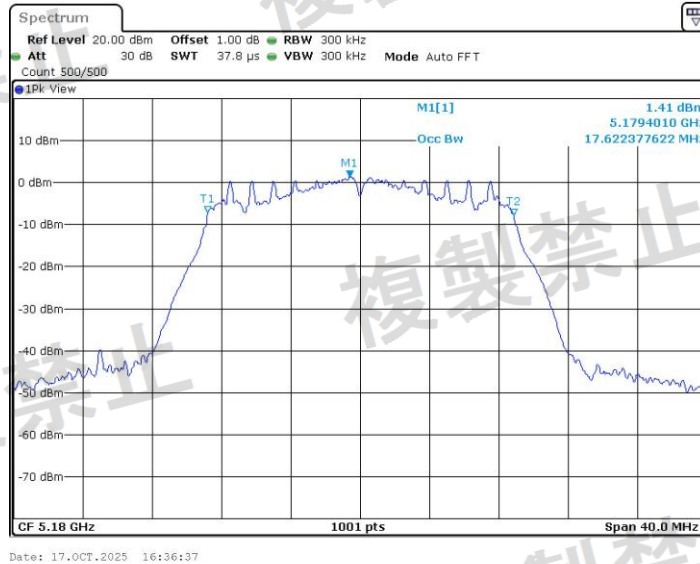


11N20SISO_Ant1_5180

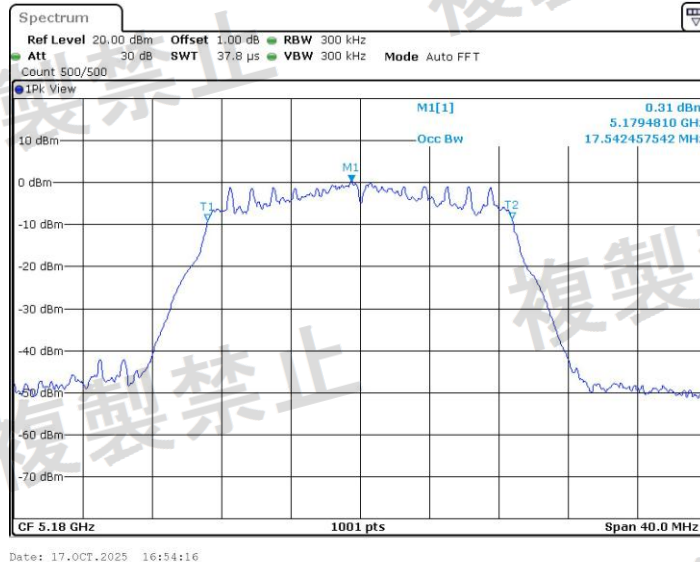


11N20SISO_Ant2_5180

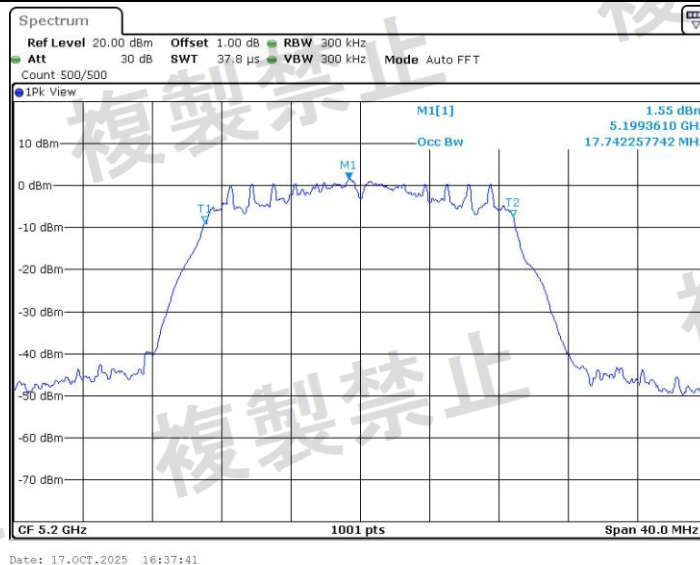


11N20SISO_Ant1_5200

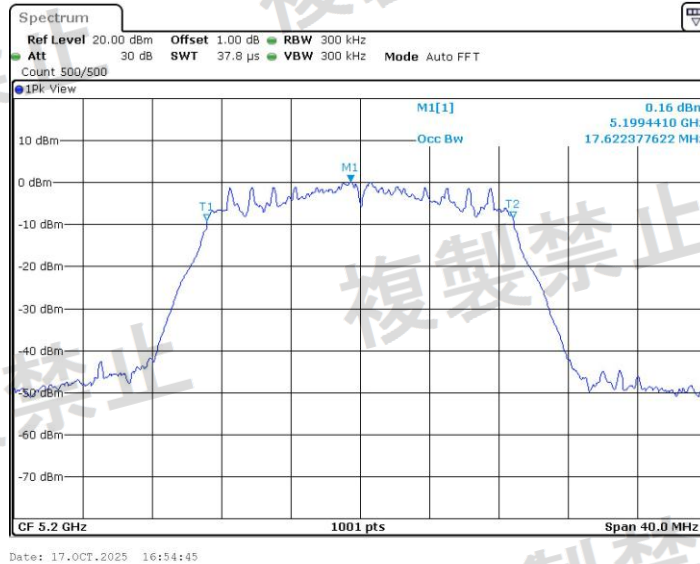


11N20SISO_Ant2_5200

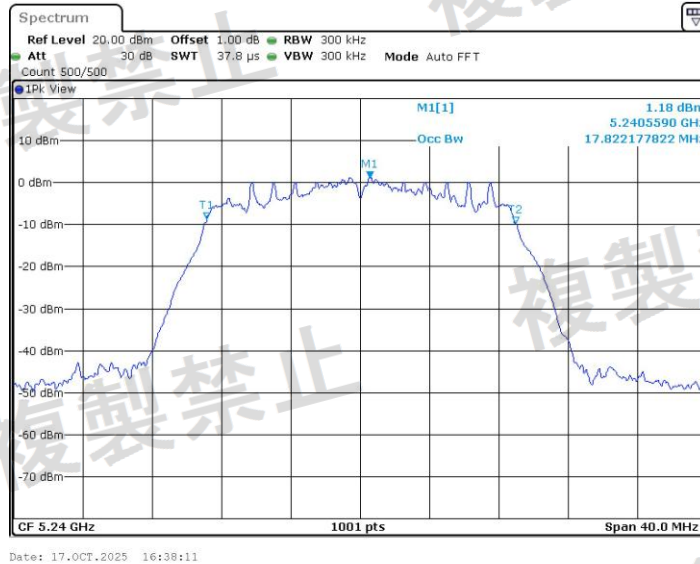


11N20SISO_Ant1_5240

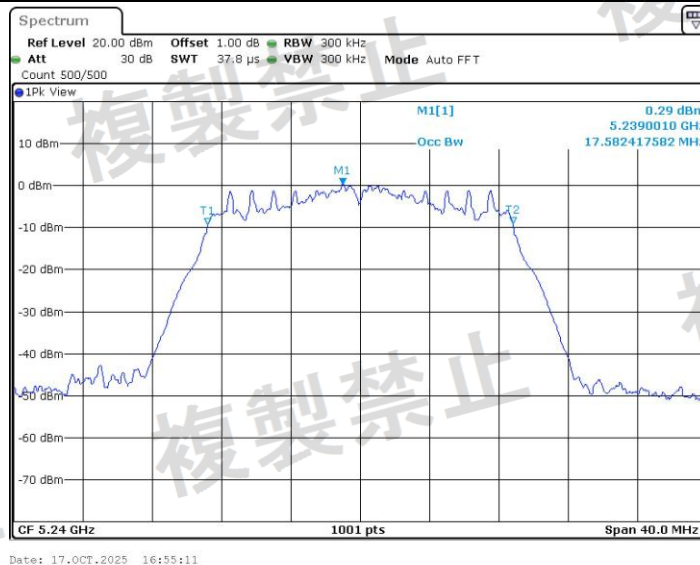


11N20SISO_Ant2_5240

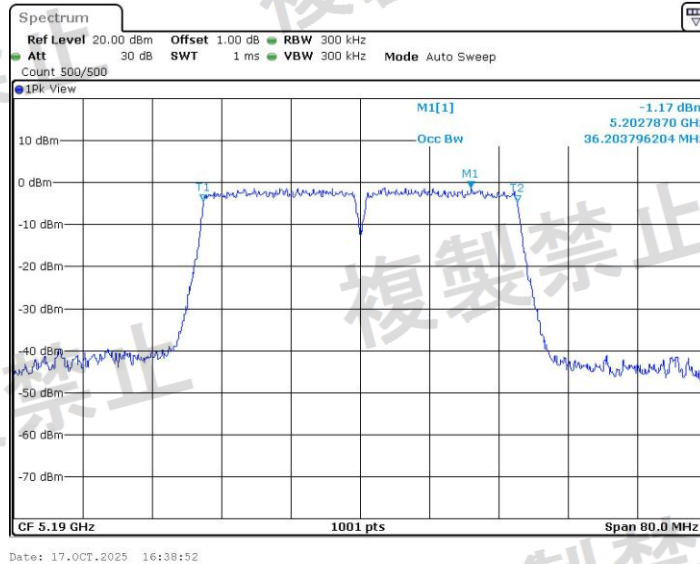


11N40SISO_Ant1_5190

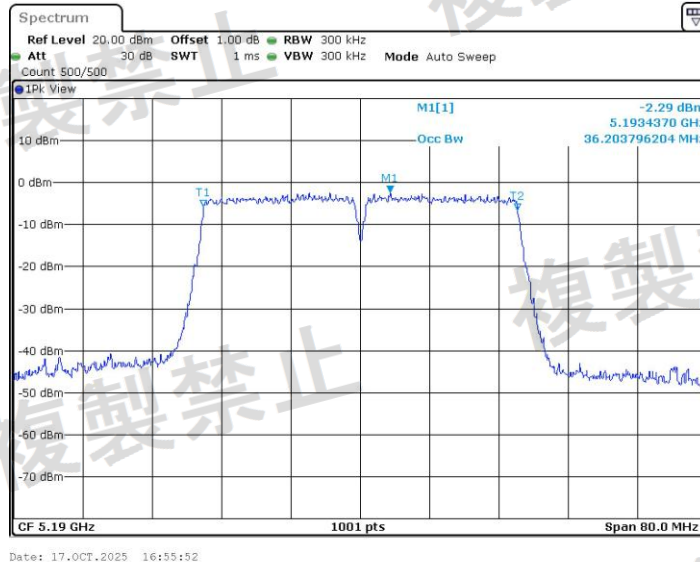


11N40SISO_Ant2_5190

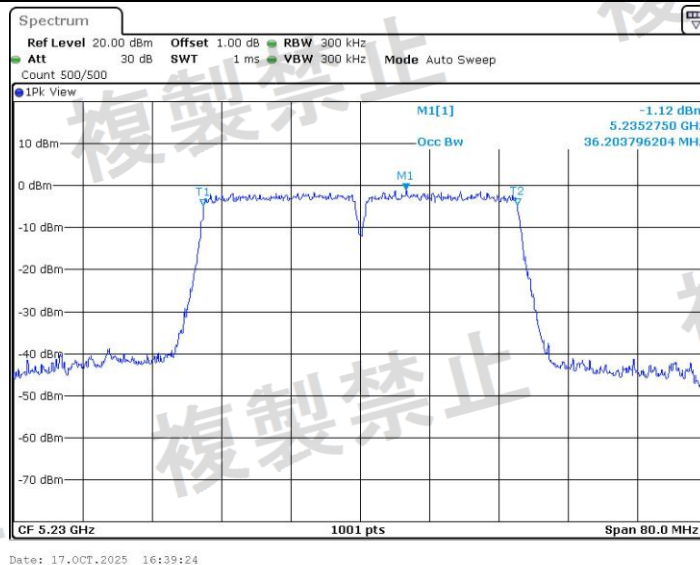


11N40SISO_Ant1_5230

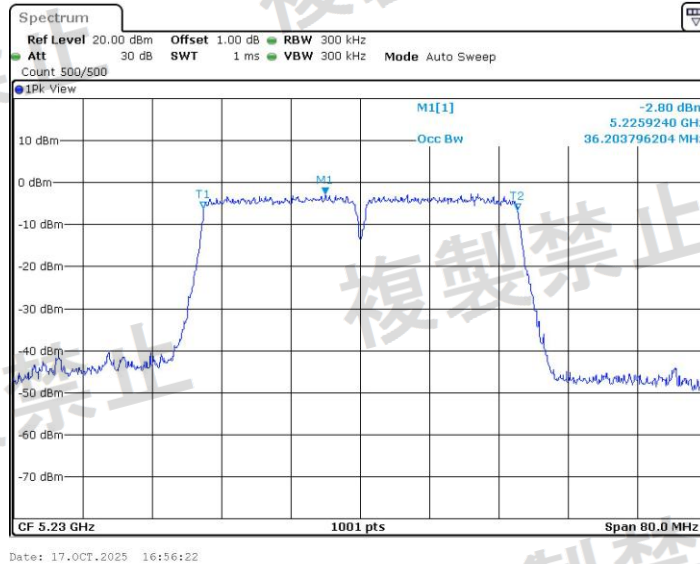


11N40SISO_Ant2_5230

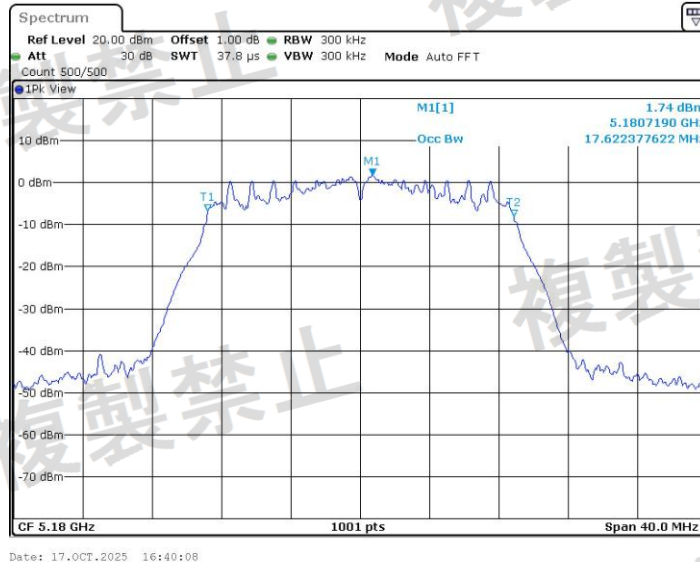


11AC20SISO_Ant1_5180

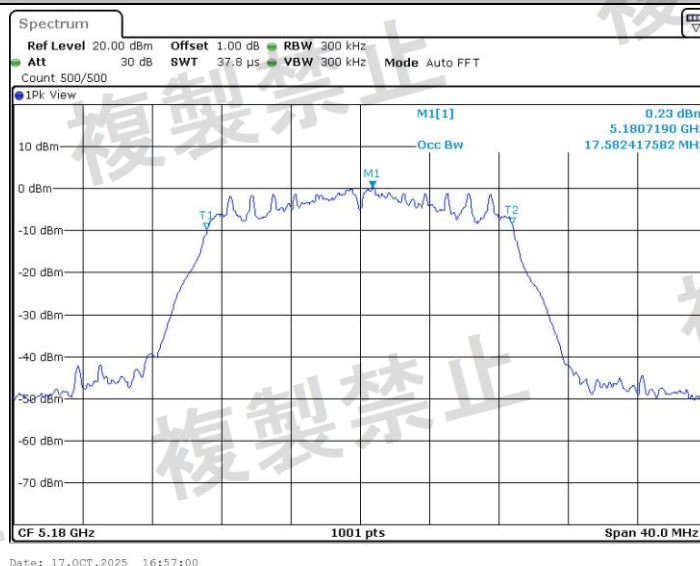


11AC20SISO_Ant2_5180

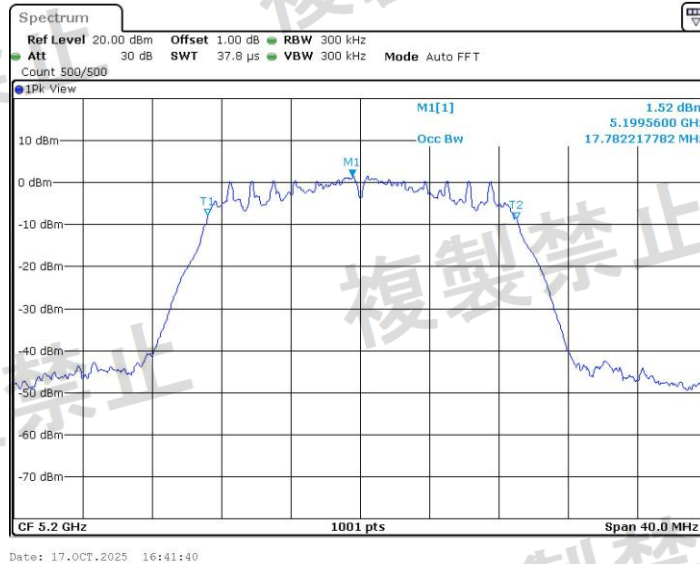


11AC20SISO_Ant1_5200

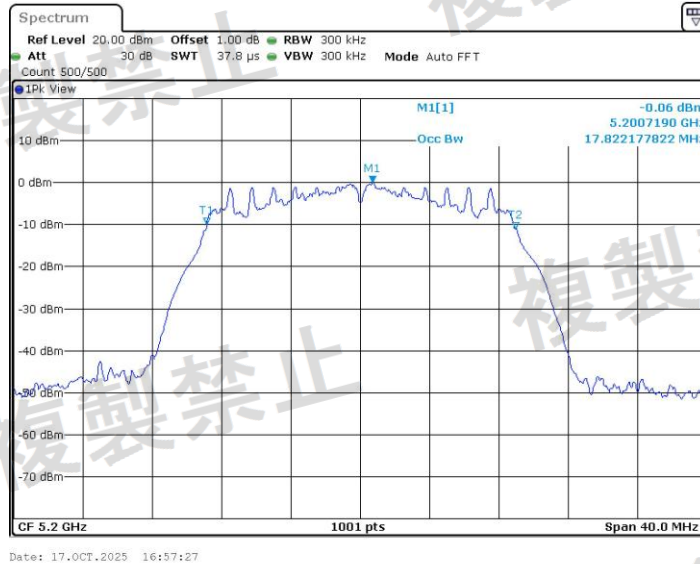


11AC20SISO_Ant2_5200

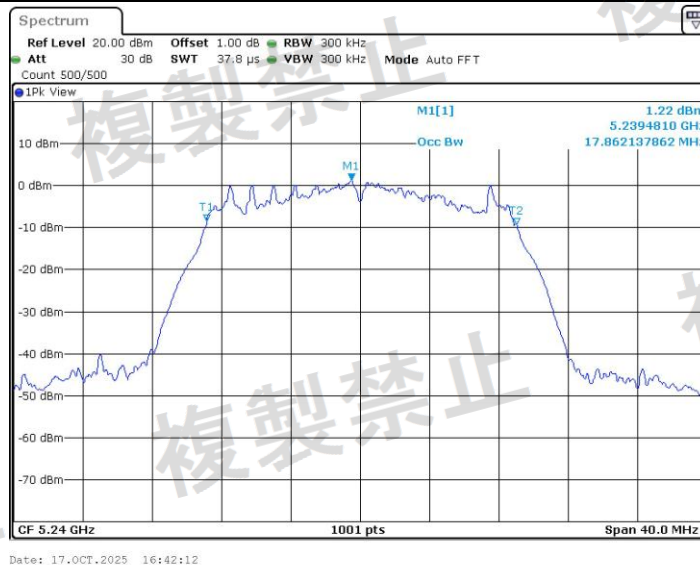


11AC20SISO_Ant1_5240

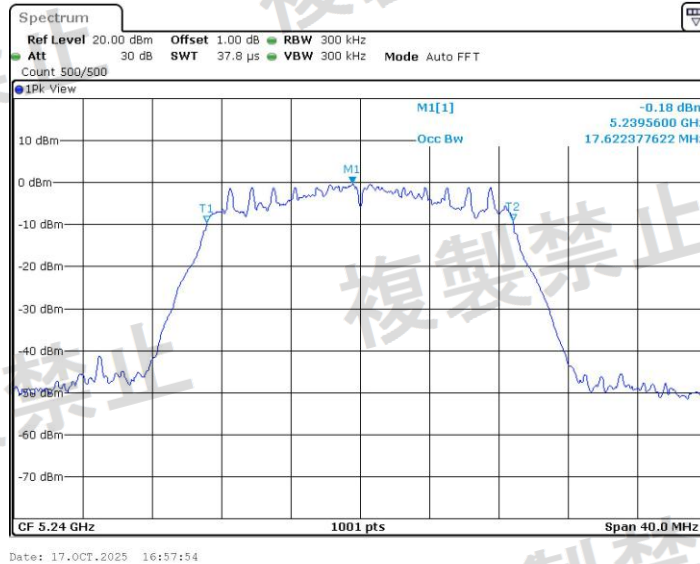

11AC20SISO_Ant2_5240

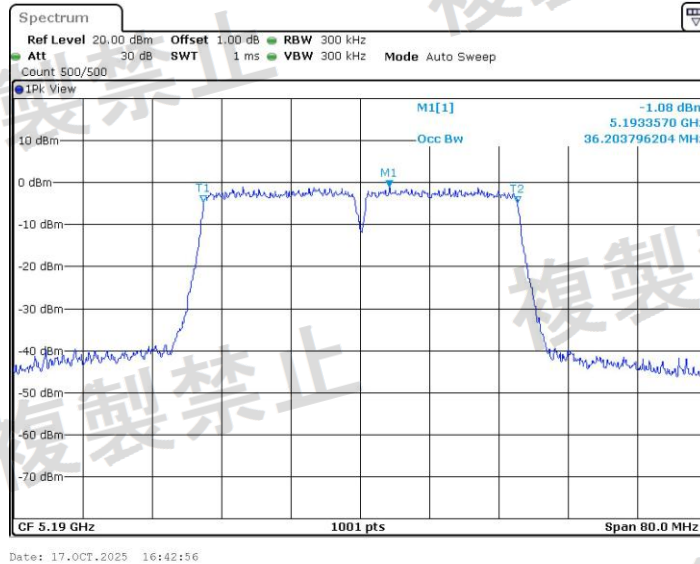


11AC40SISO_Ant1_5190

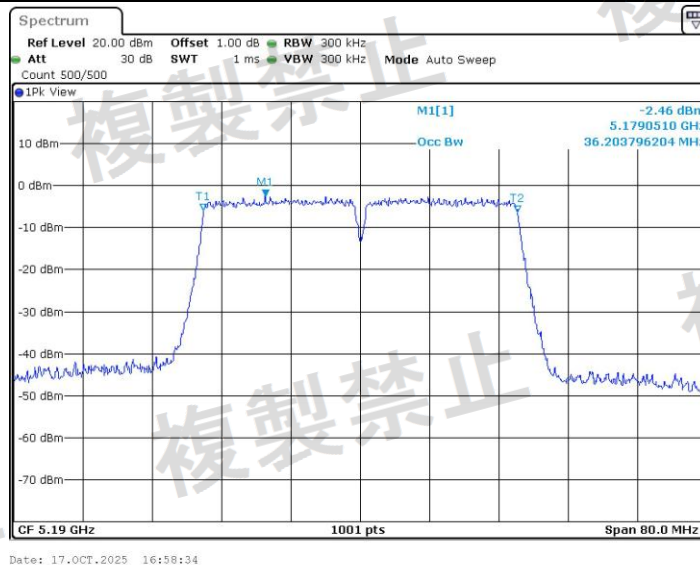


11AC40SISO_Ant2_5190




11AC40SISO_Ant1_5230

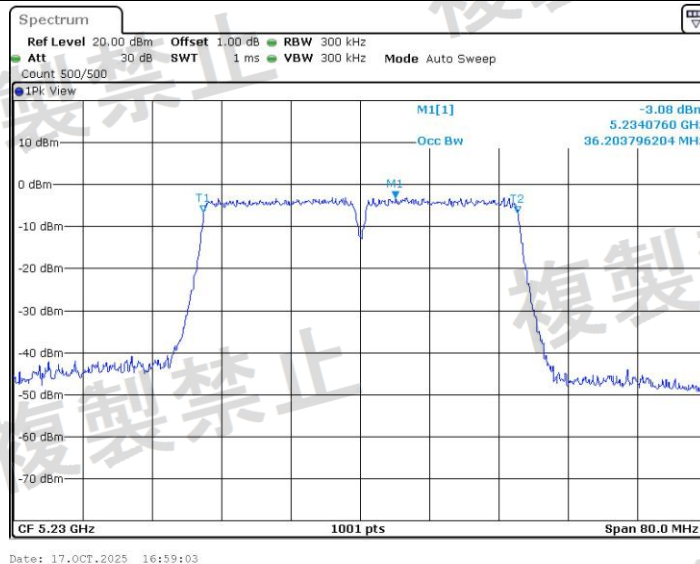


11AC40SISO_Ant2_5230

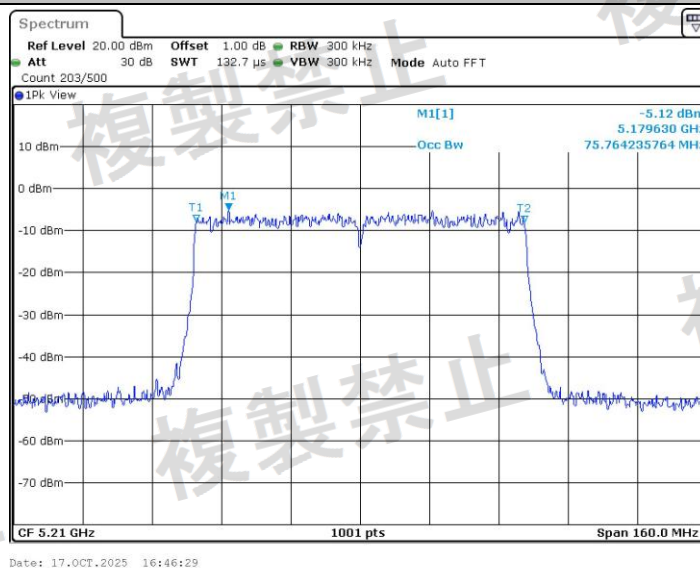

11AC80SISO_Ant1_5210

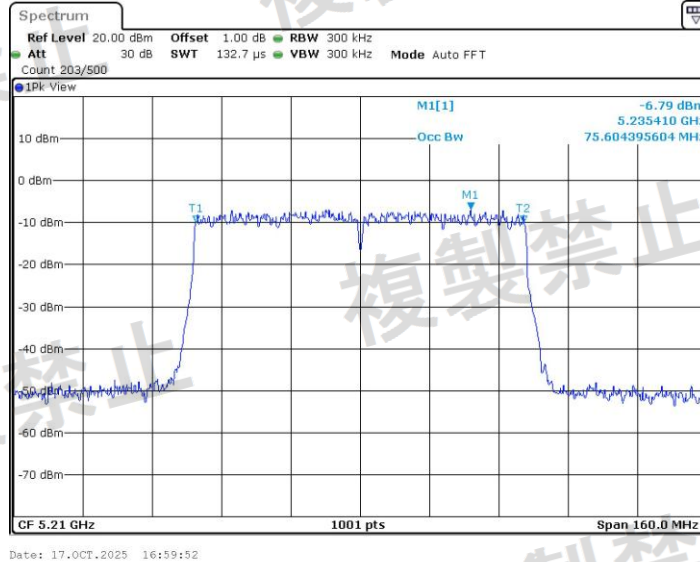


11AC80SISO_Ant2_5210

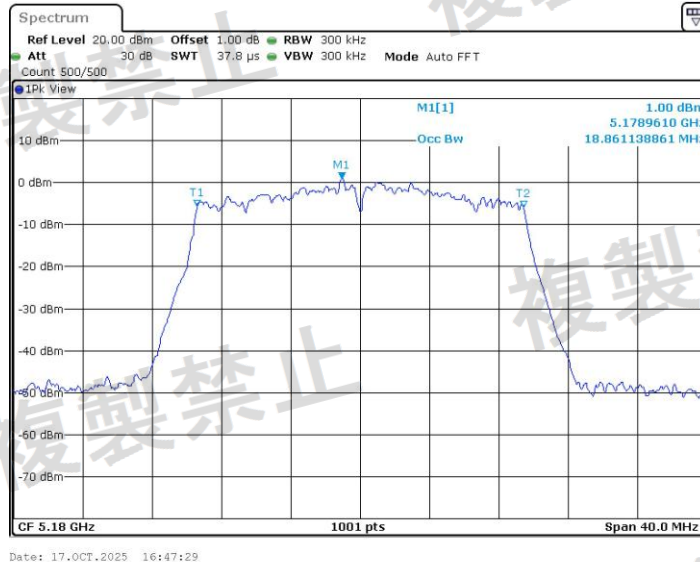


11AX20SISO_Ant1_5180




11AX20SISO_Ant2_5180

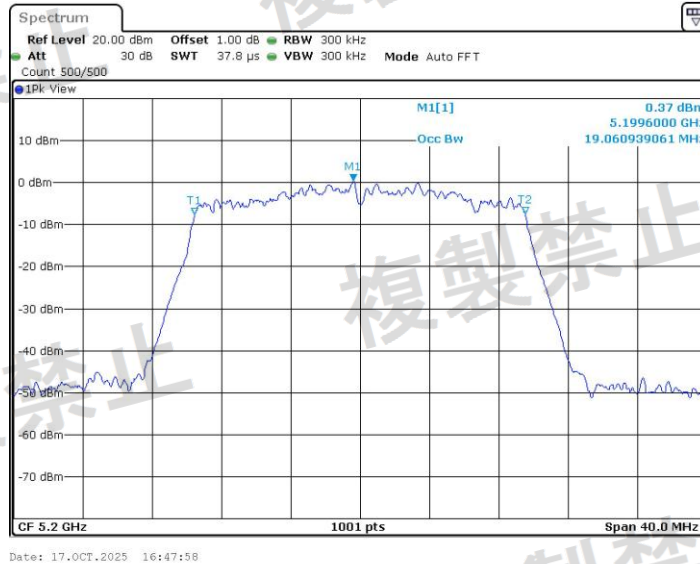

11AX20SISO_Ant1_5200

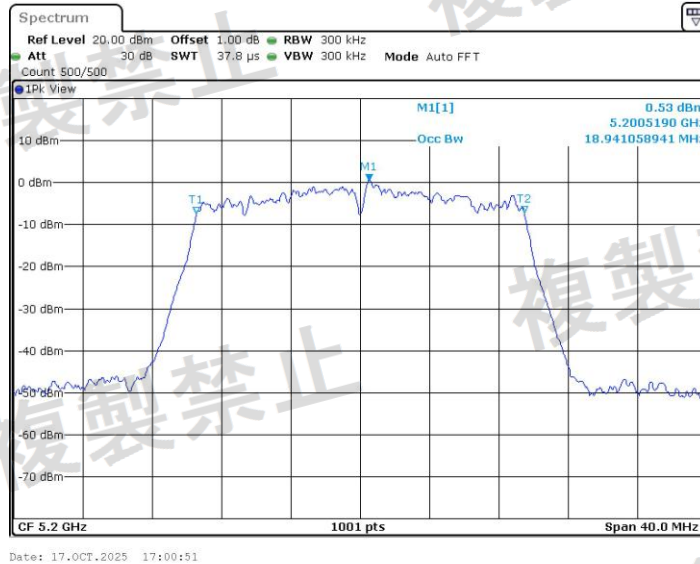


11AX20SISO_Ant2_5200

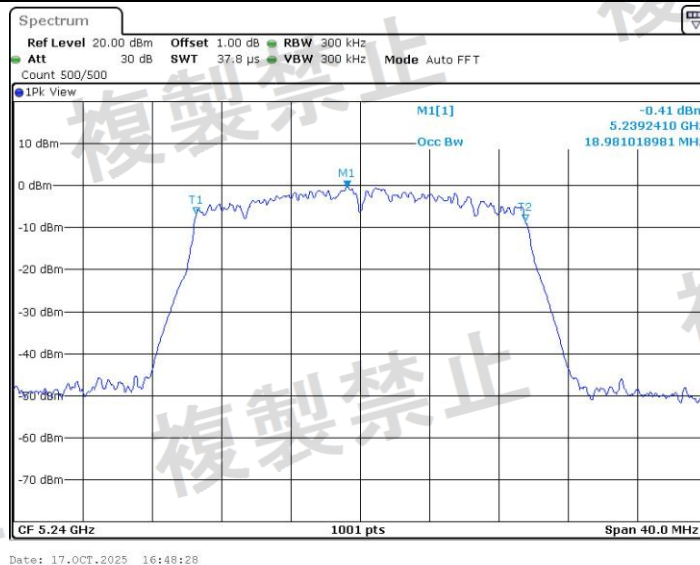


11AX20SISO_Ant1_5240




11AX20SISO_Ant2_5240

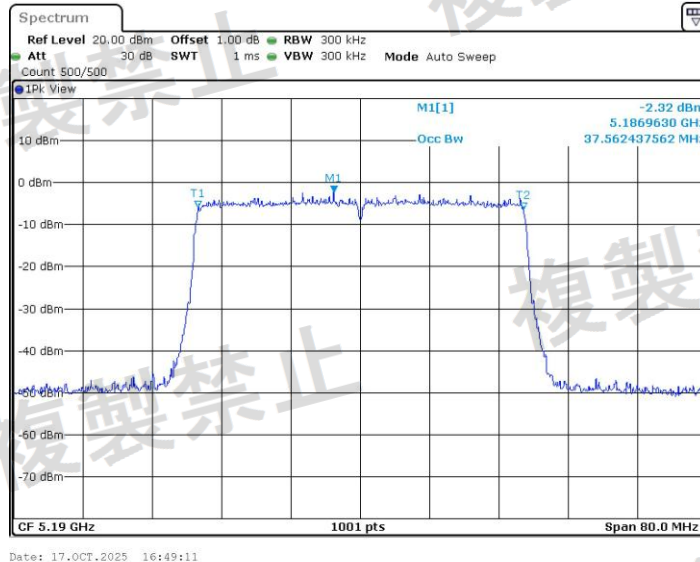


11AX40SISO_Ant1_5190

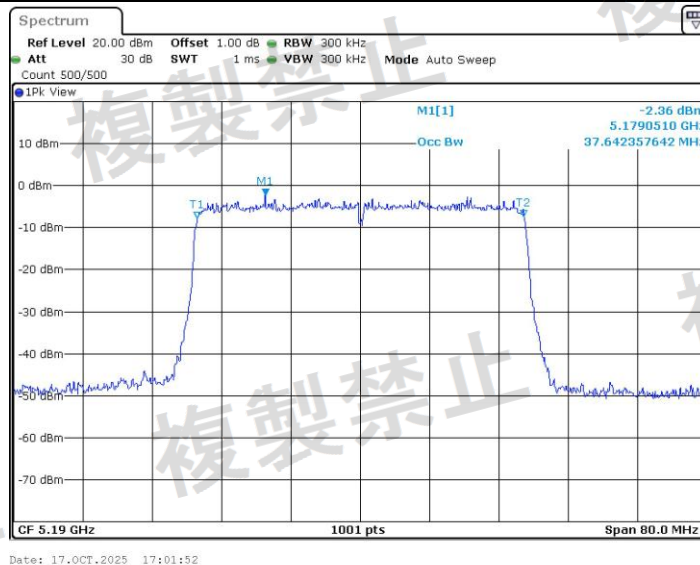


11AX40SISO_Ant2_5190

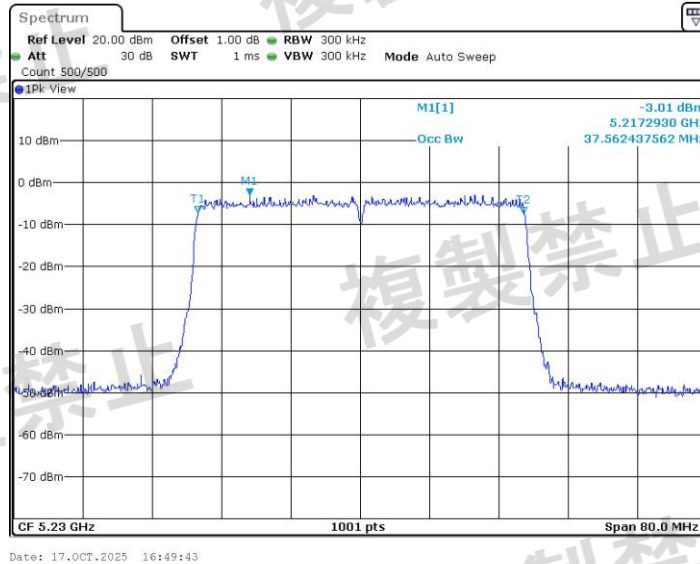


11AX40SISO_Ant1_5230

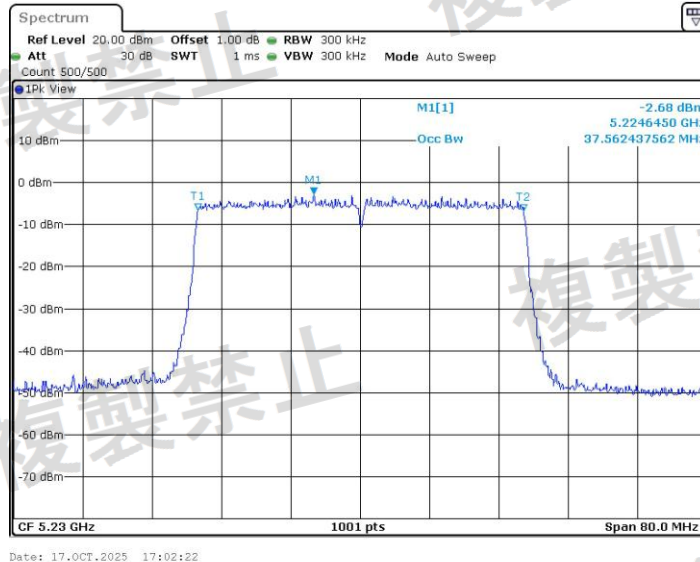

11AX40SISO_Ant2_5230

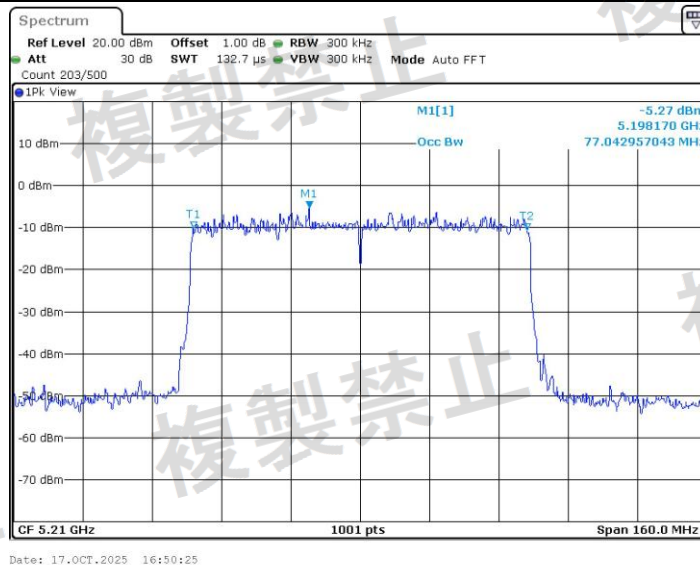



11AX80SISO_Ant1_5210

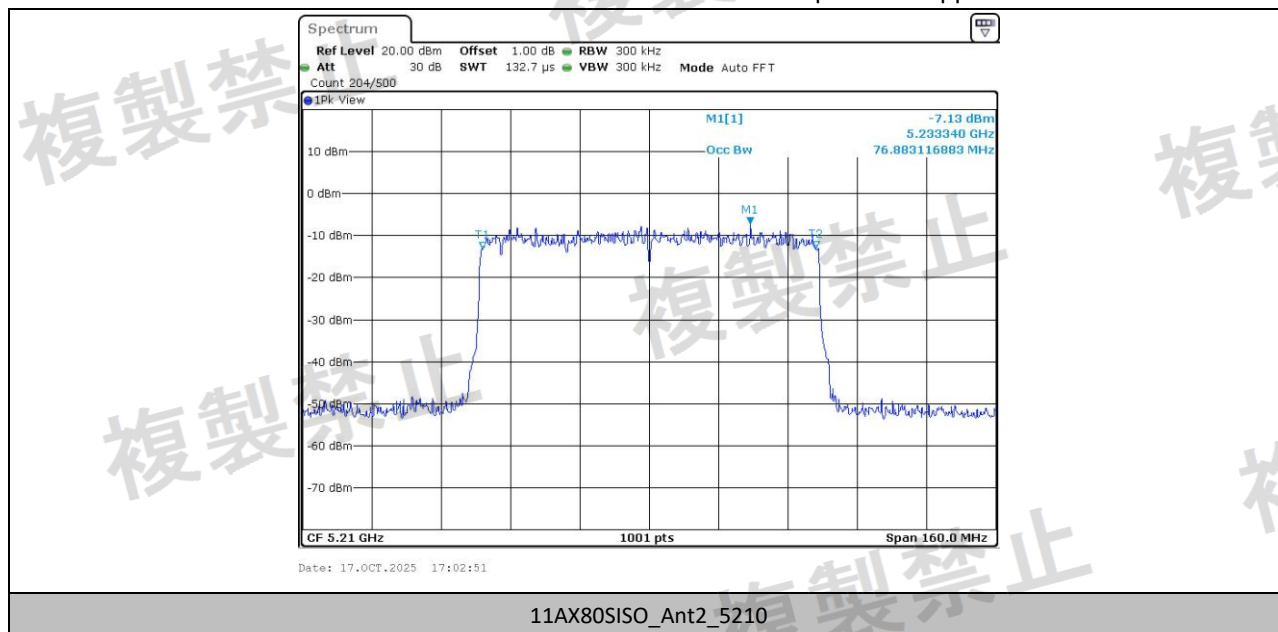


Appendix C: Leak Power of Neighboring Channels


Worst Test Graphs

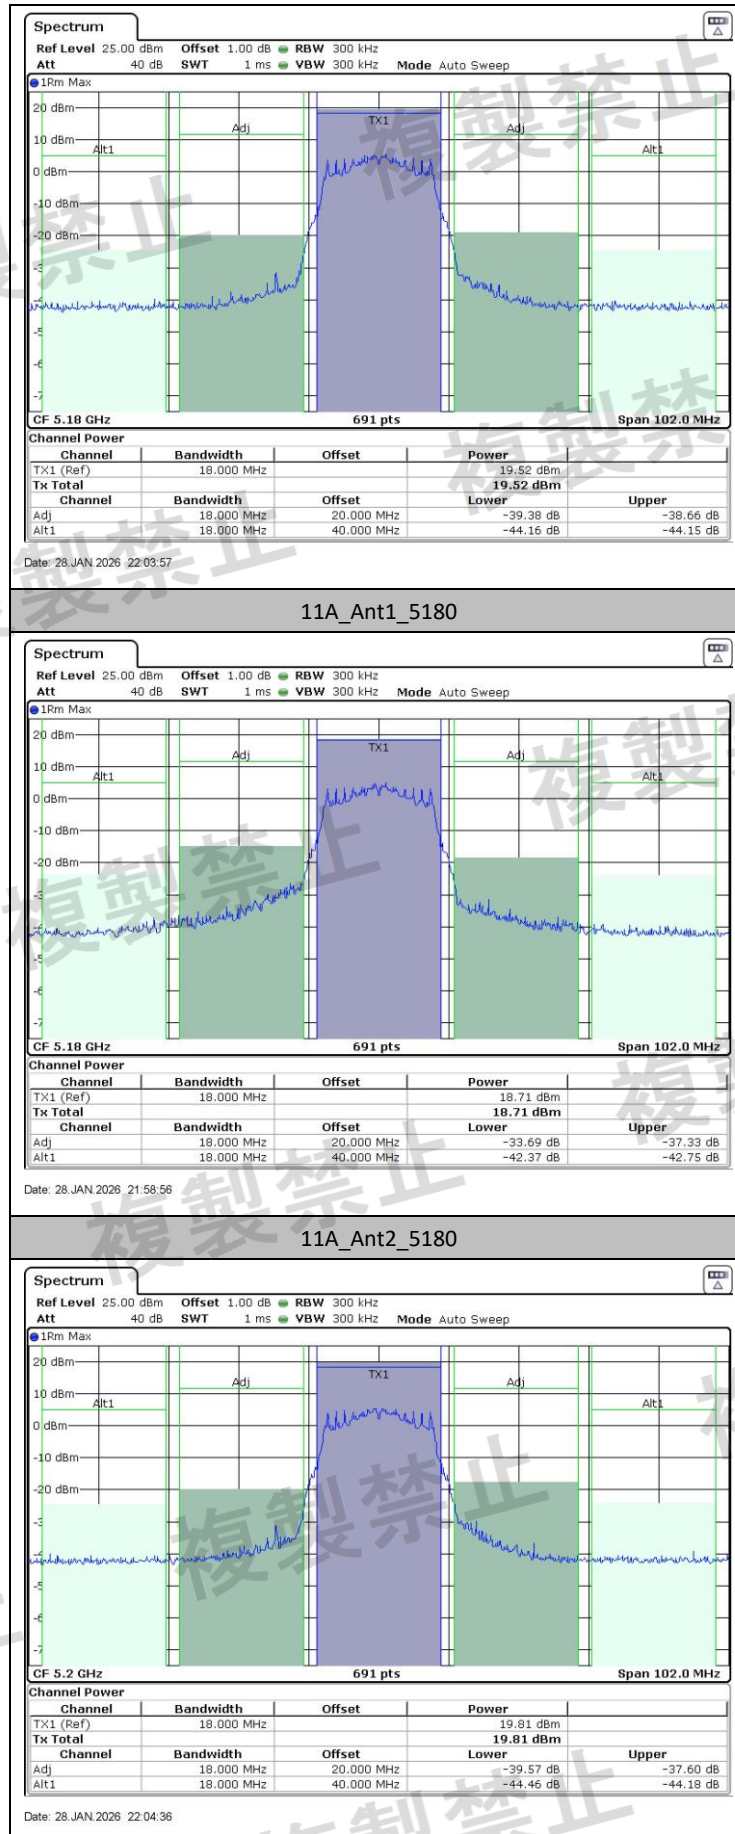

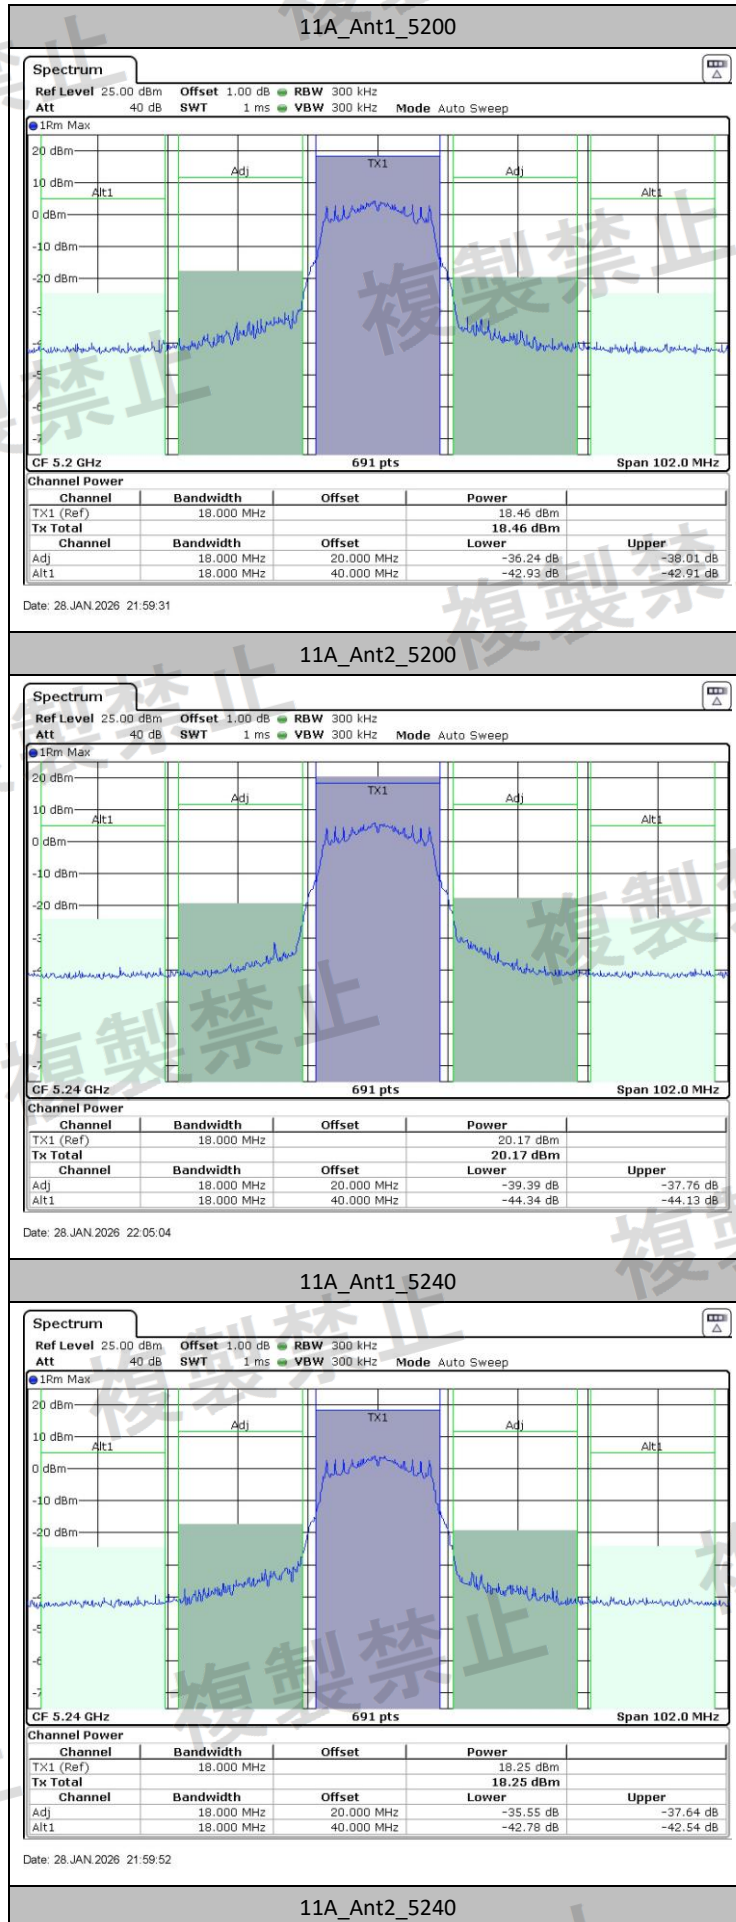


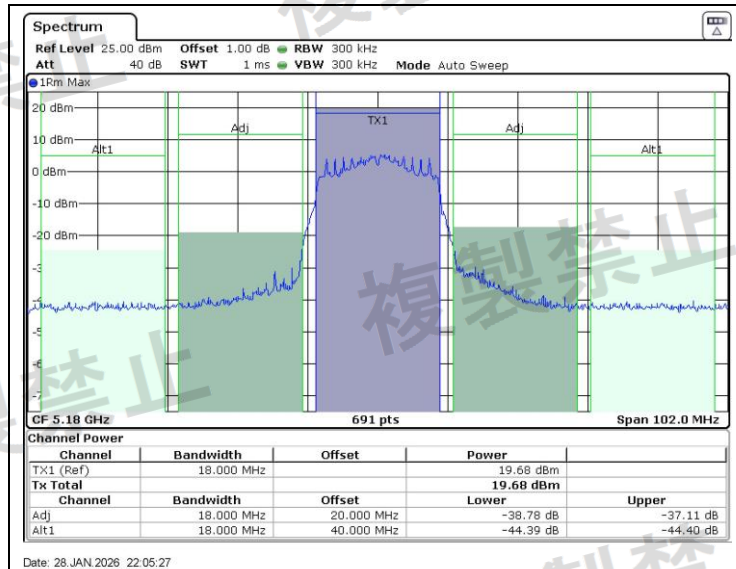


11N20SISO_Ant1_5180

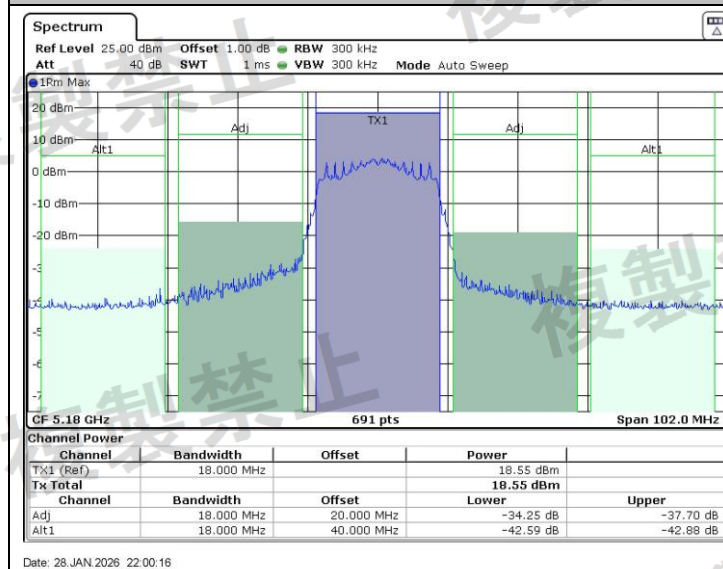


11N20SISO_Ant2_5180

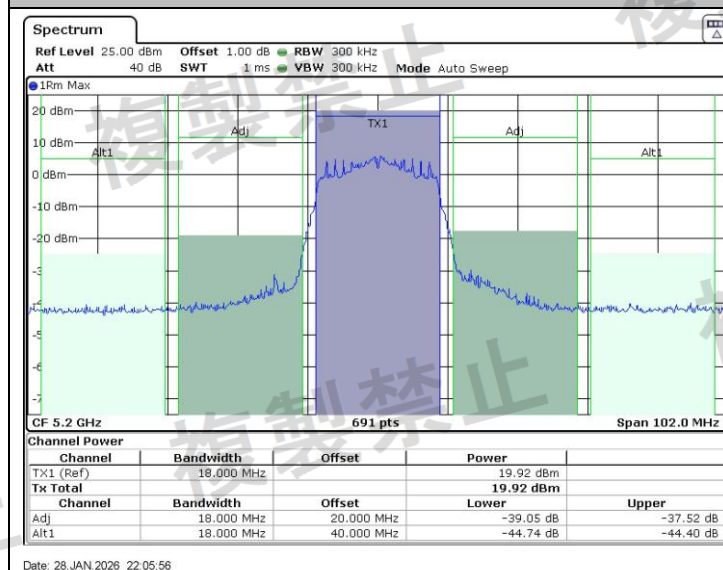


11N20SISO_Ant1_5200

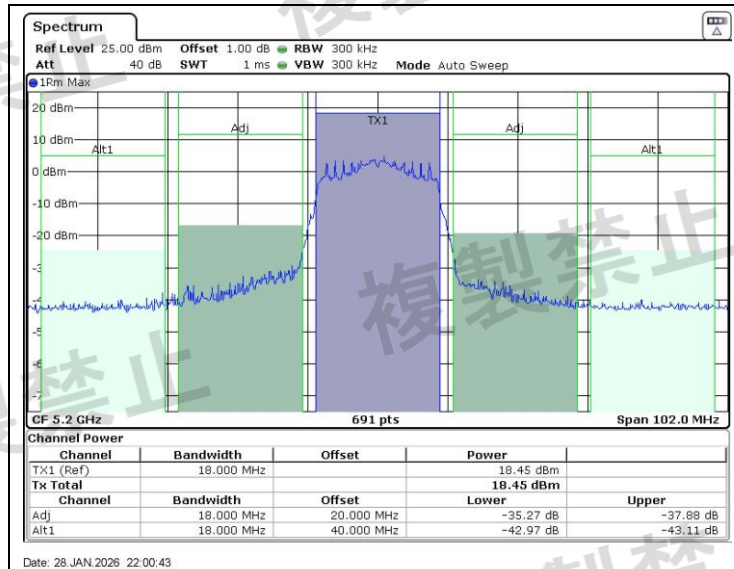


11N20SISO_Ant2_5200

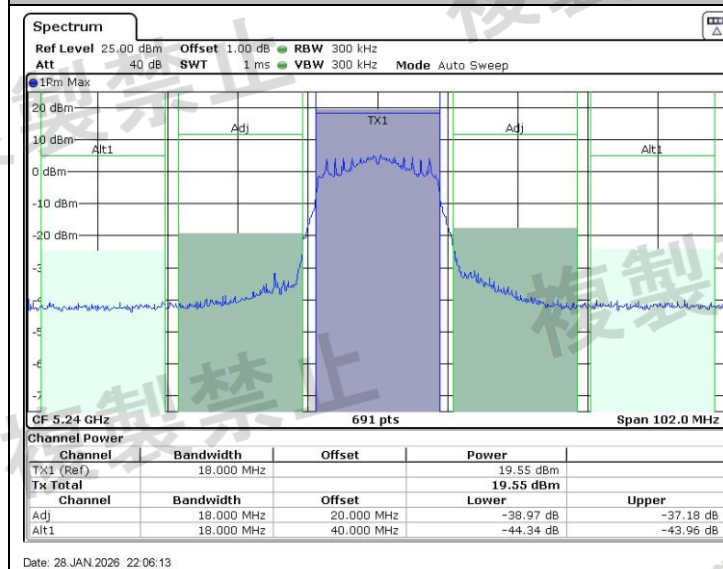


11N20SISO_Ant1_5240

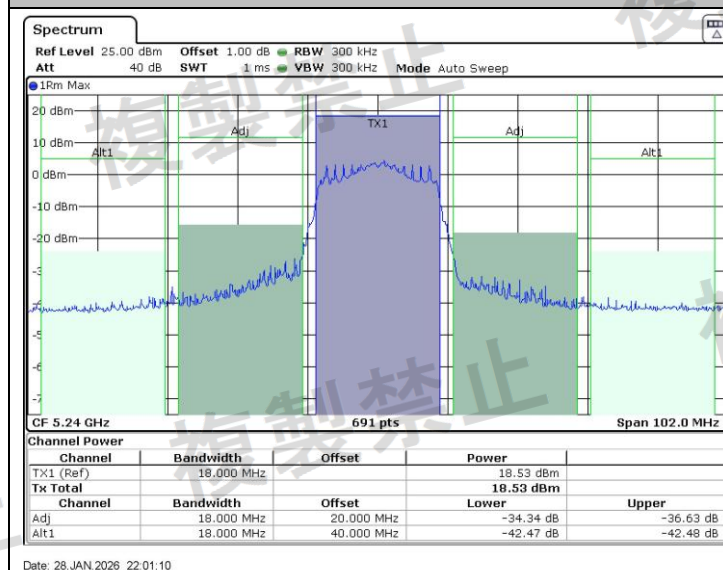

11N20SISO_Ant2_5240

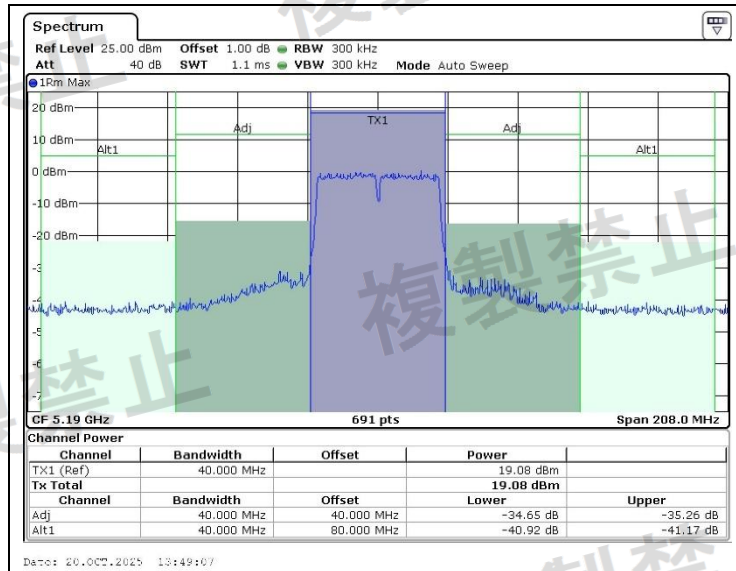


11N40SISO_Ant1_5190

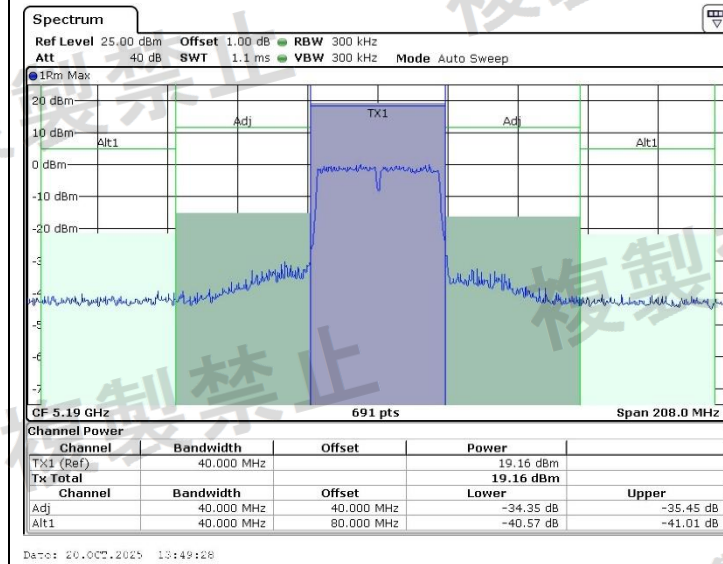


11N40SISO_Ant2_5190




11N40SISO_Ant1_5230

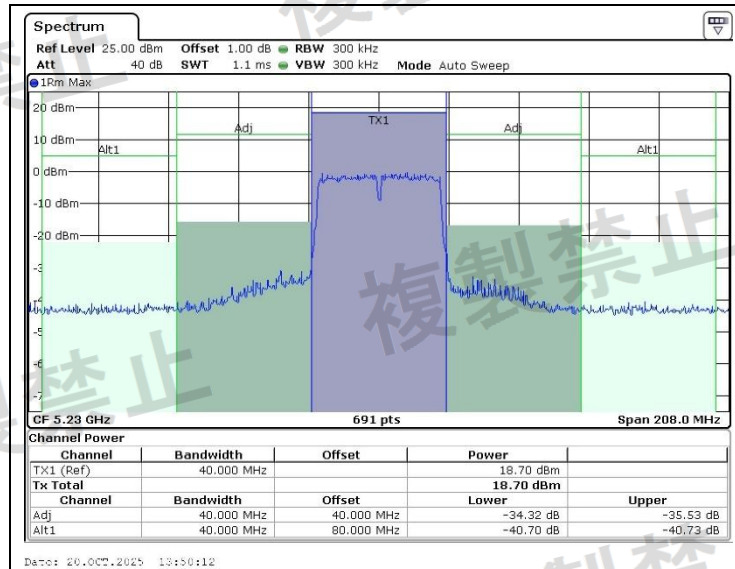


11N40SISO_Ant2_5230

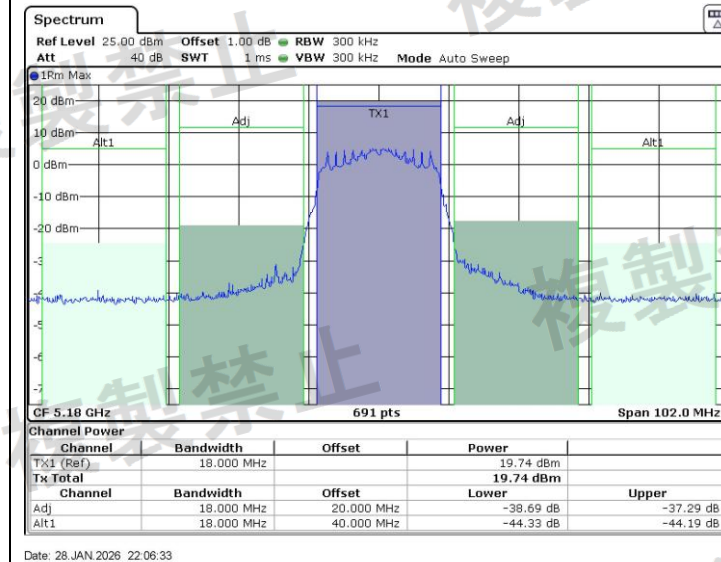


11AC20SISO_Ant1_5180

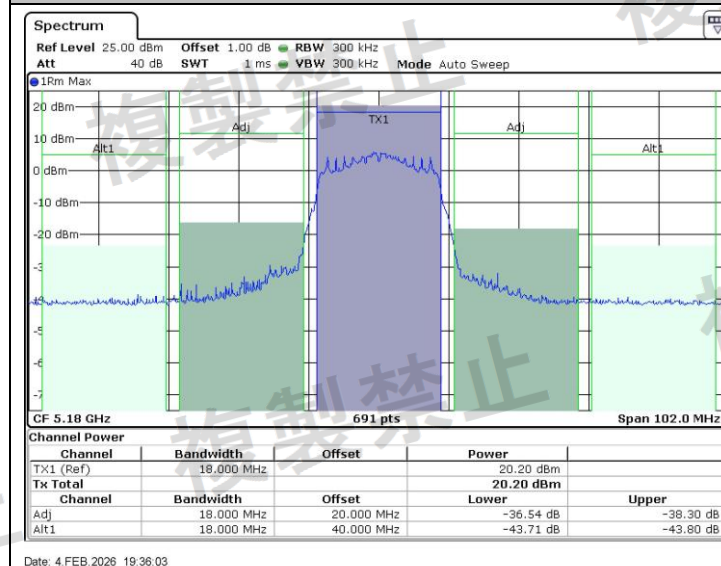


11AC20SISO_Ant2_5180

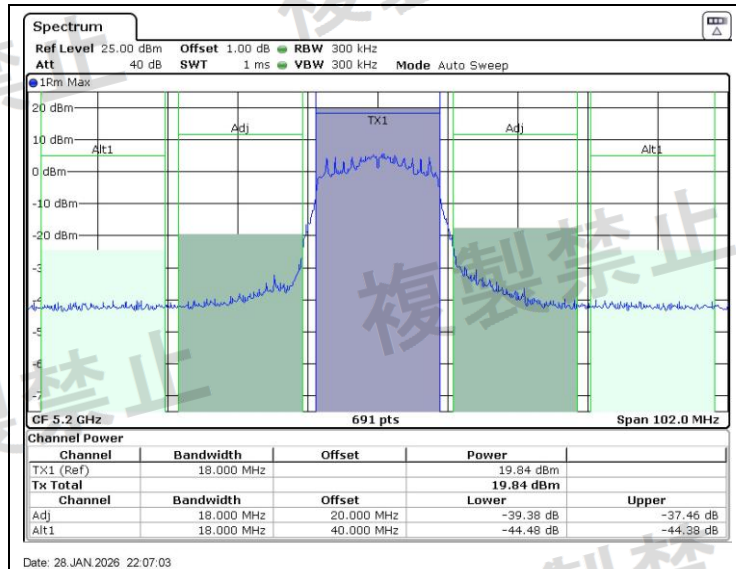


11AC20SISO_Ant1_5200

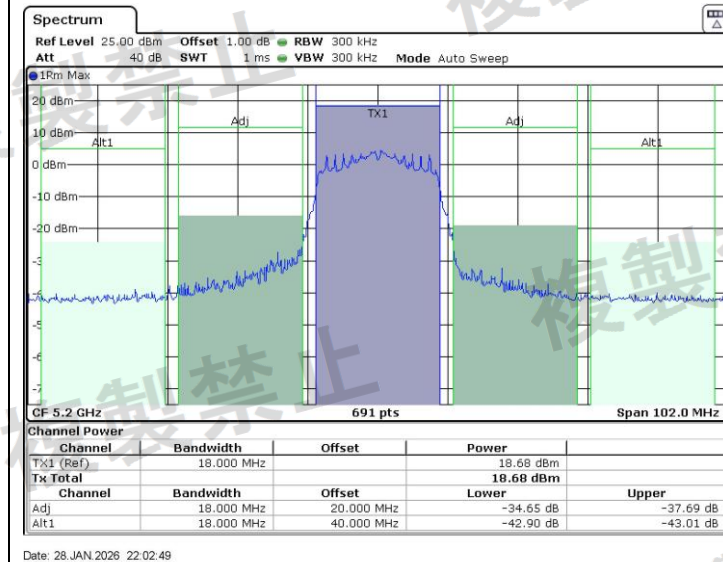


11AC20SISO_Ant2_5200

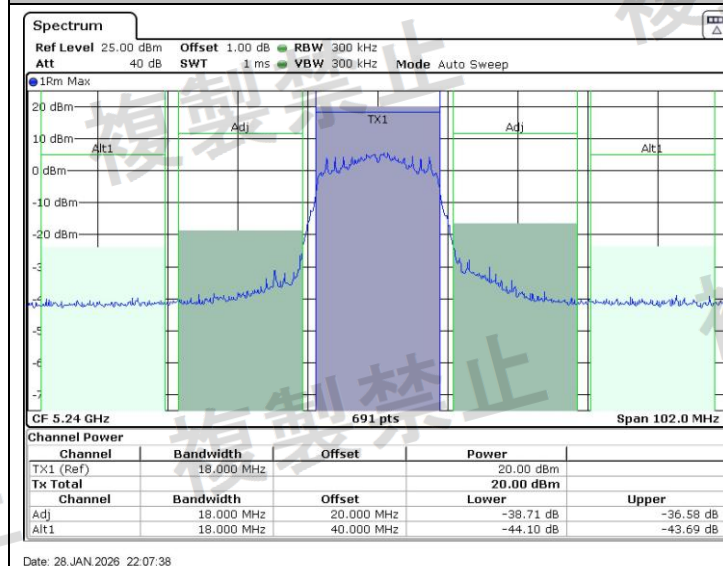


11AC20SISO_Ant1_5240

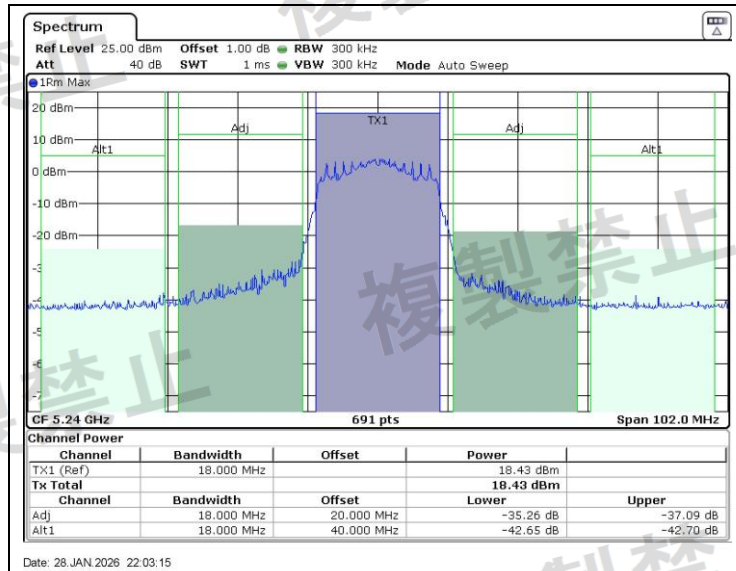

11AC20SISO_Ant2_5240

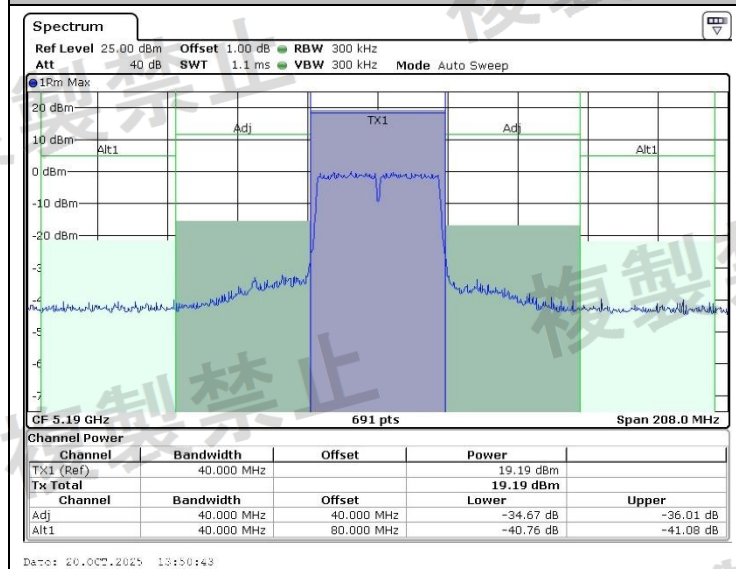


11AC40SISO_Ant1_5190

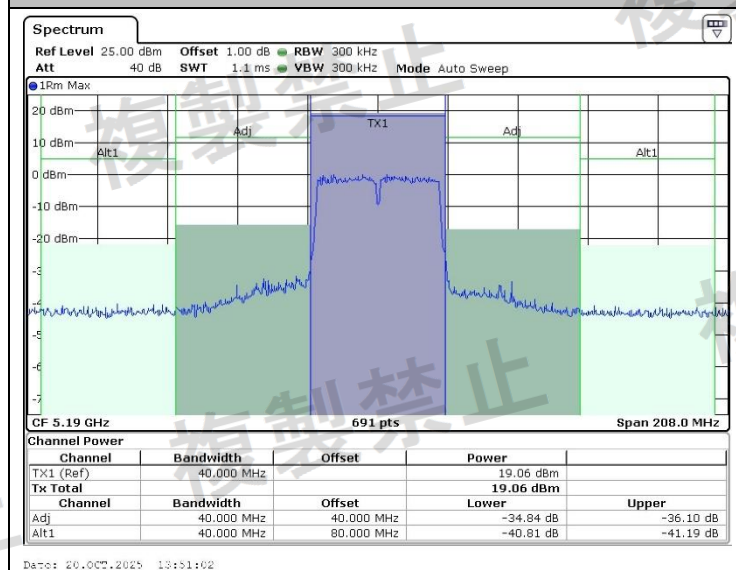


11AC40SISO_Ant2_5190



11AC40SISO_Ant1_5230

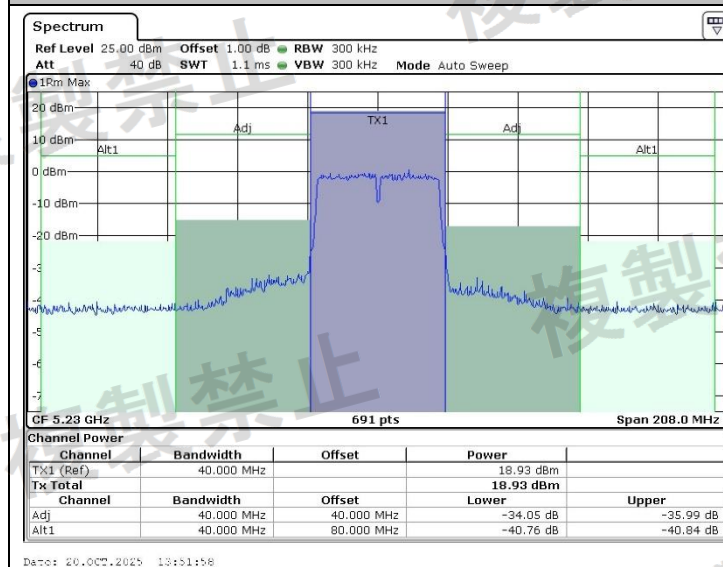


11AC40SISO_Ant2_5230

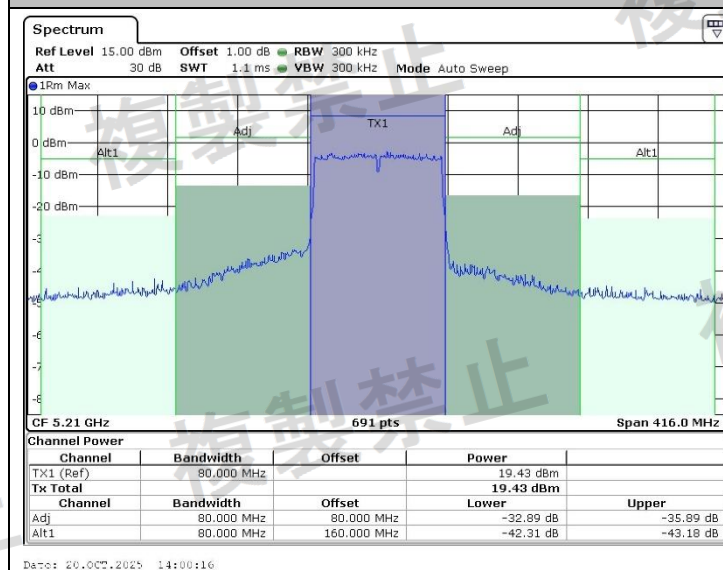


11AC80SISO_Ant1_5210



11AC80SISO_Ant2_5210

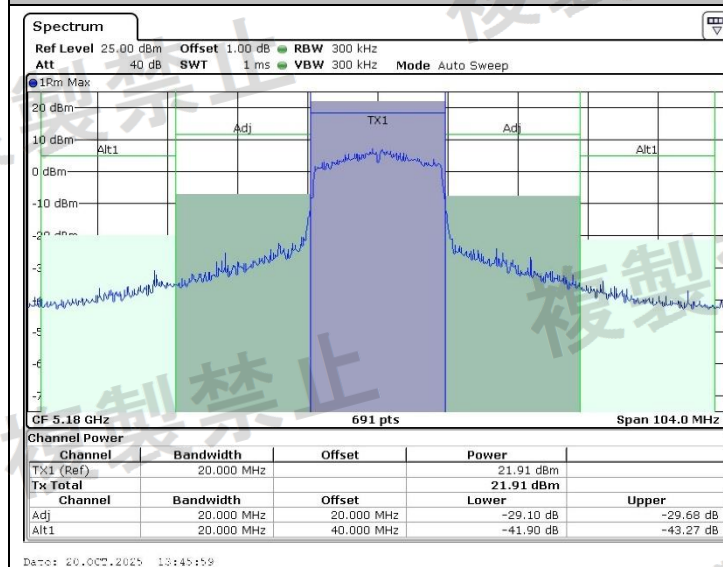


11AX20SISO_Ant1_5180

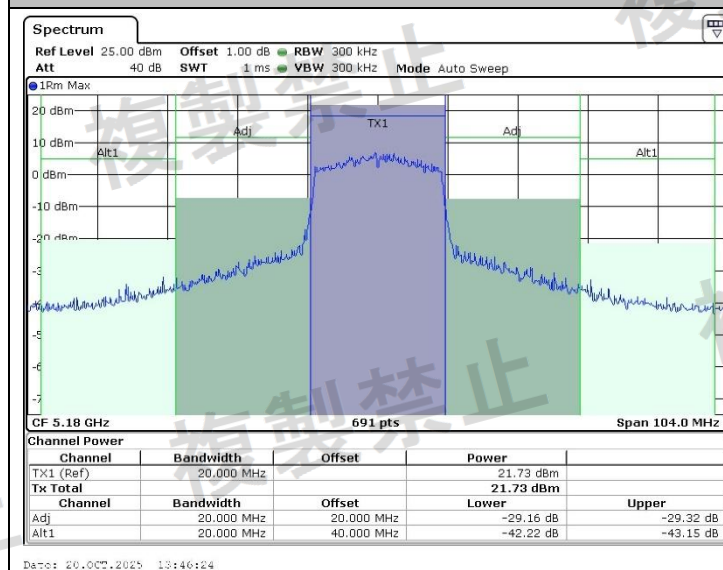


11AX20SISO_Ant2_5180




11AX20SISO_Ant1_5200

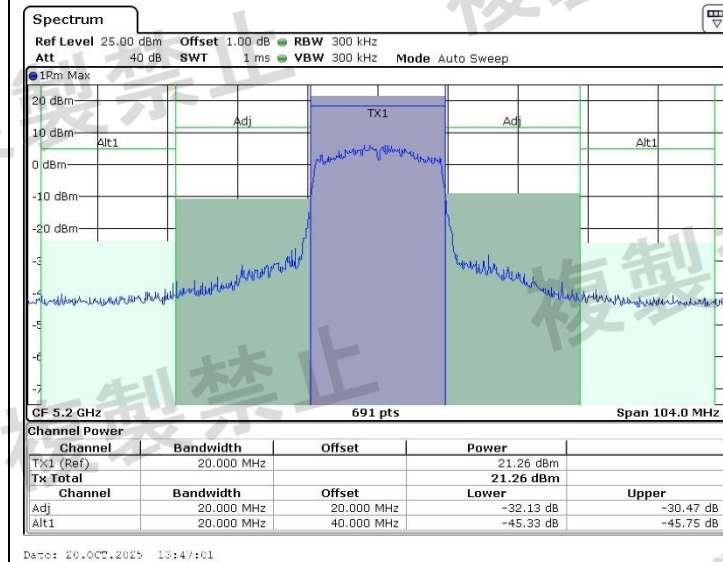


11AX20SISO_Ant2_5200

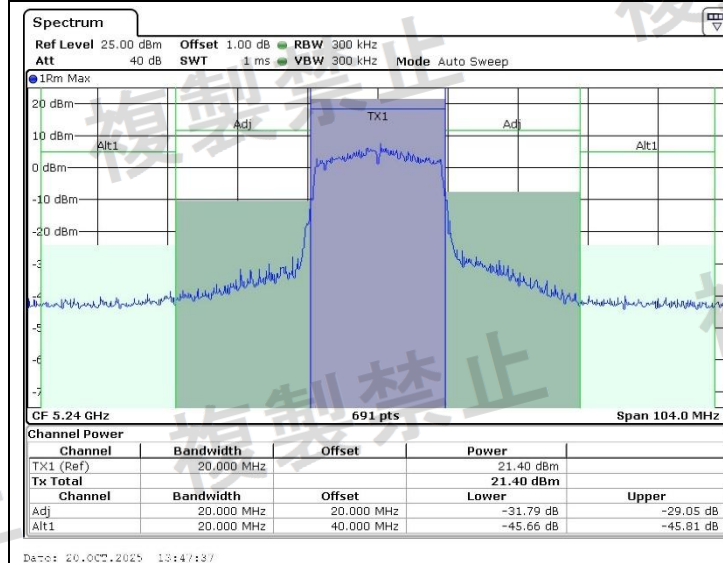

11AX20SISO_Ant1_5240

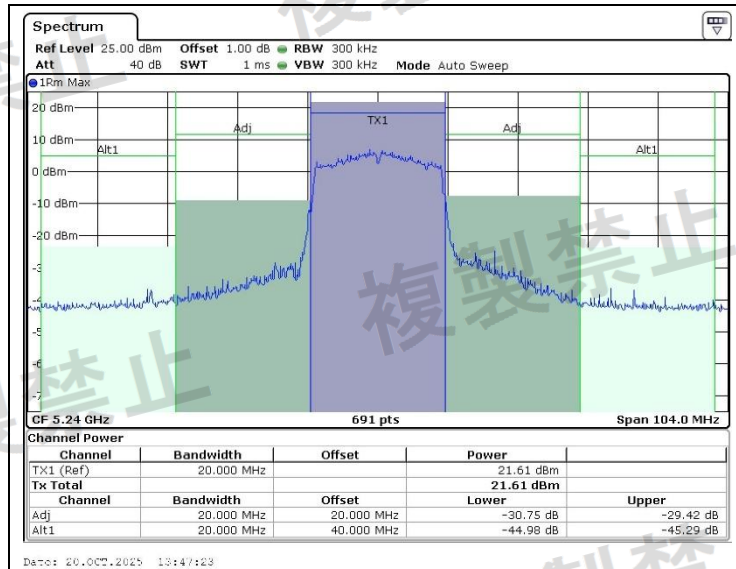

11AX20SISO_Ant2_5240

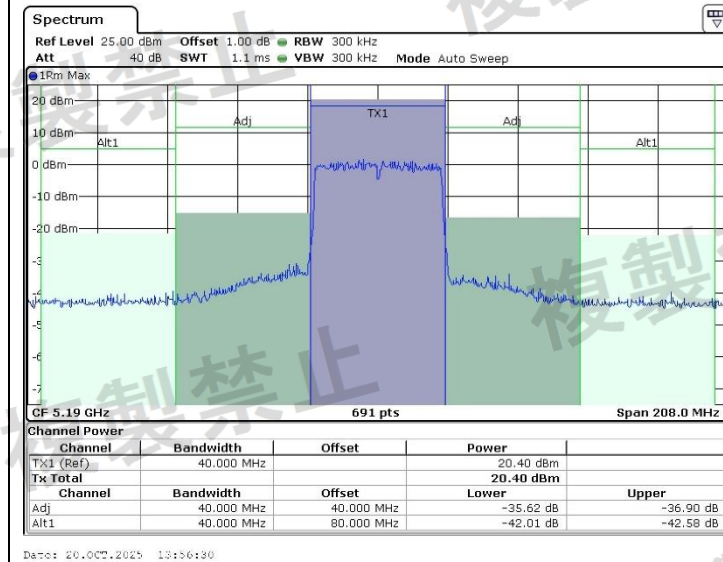


11AX40SISO_Ant1_5190



11AX40SISO_Ant2_5190




11AX40SISO_Ant1_5230

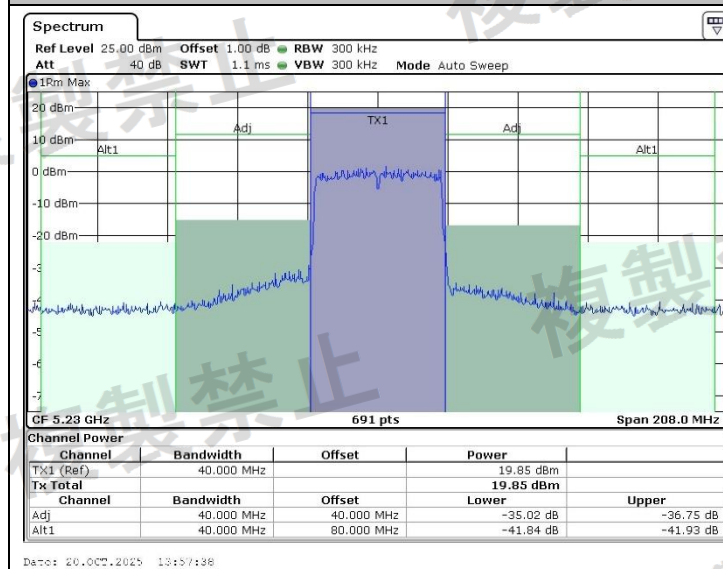

11AX40SISO_Ant2_5230




11AX80SISO_Ant1_5210

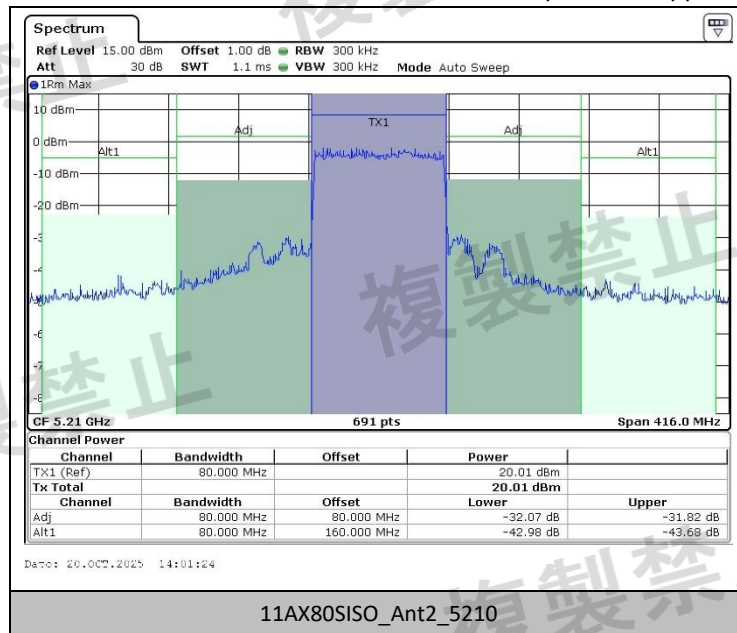



Appendix D: Leak Power Out of Band


Worst Test Graphs



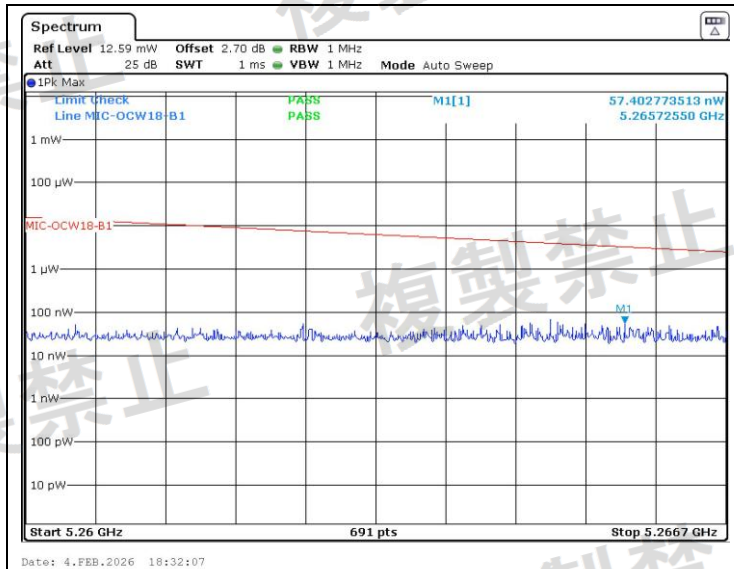


11A_Ant1_5180

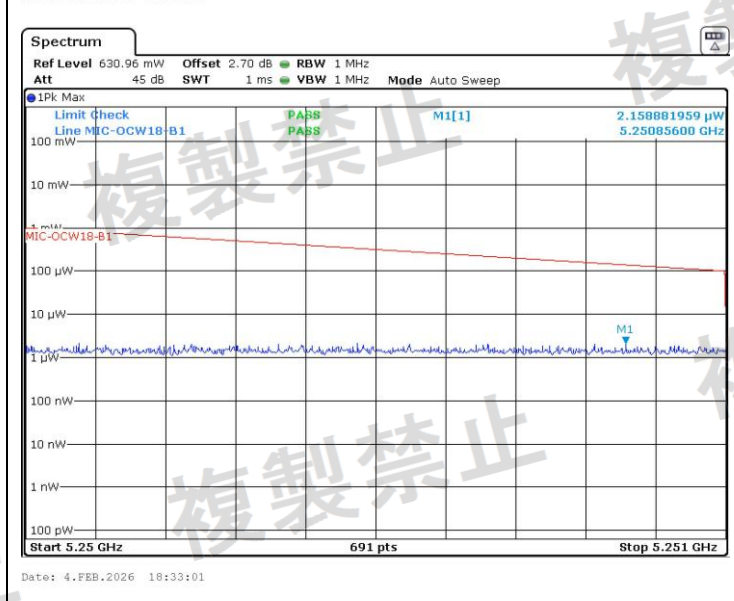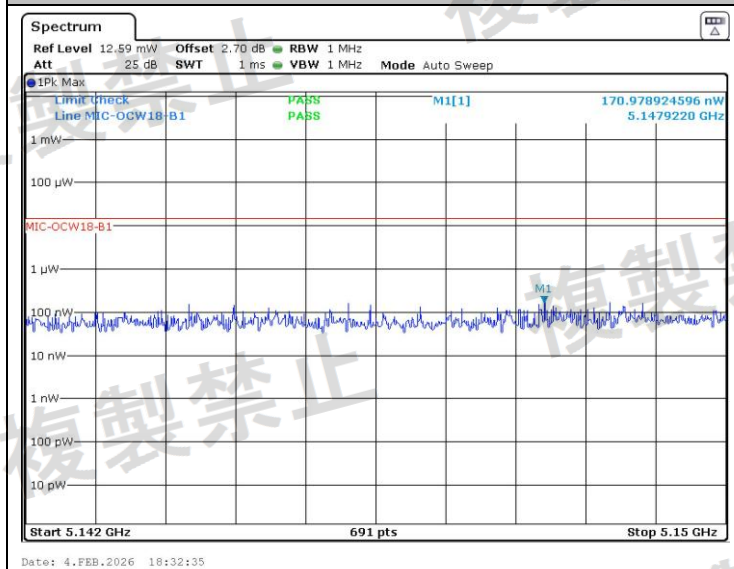

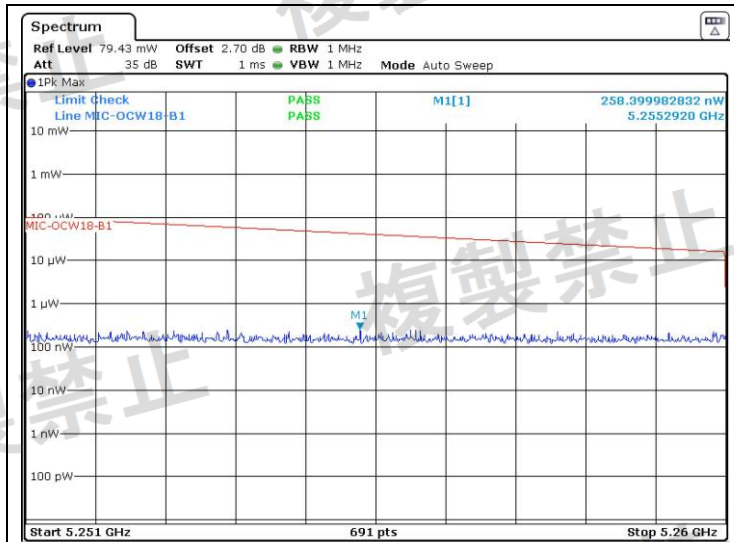


Date: 4.FEB.2026 18:33:23

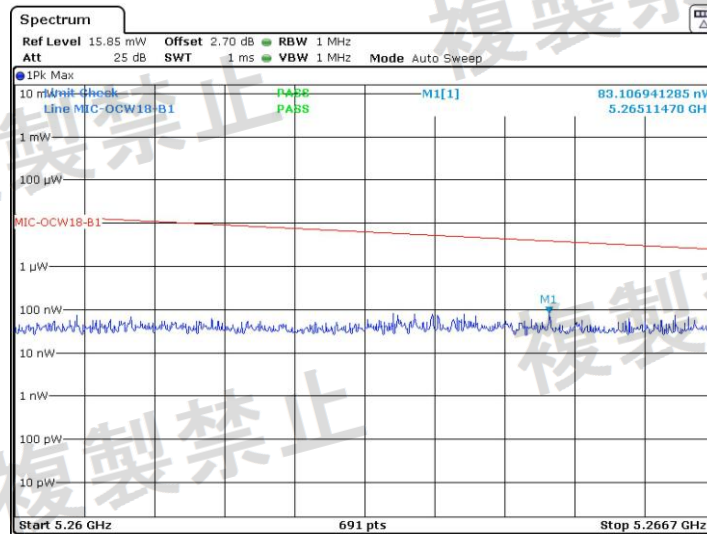



Date: 4.FEB.2026 18:33:41


11A_Ant1_5200

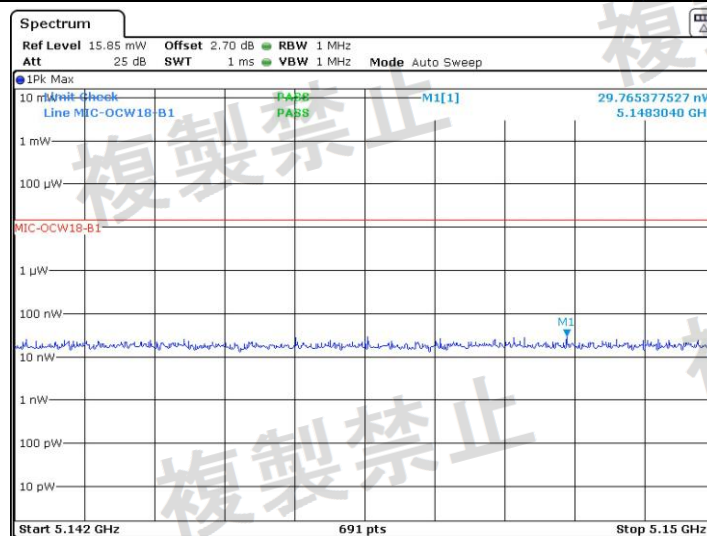



Date: 4.FEB.2026 18:34:07

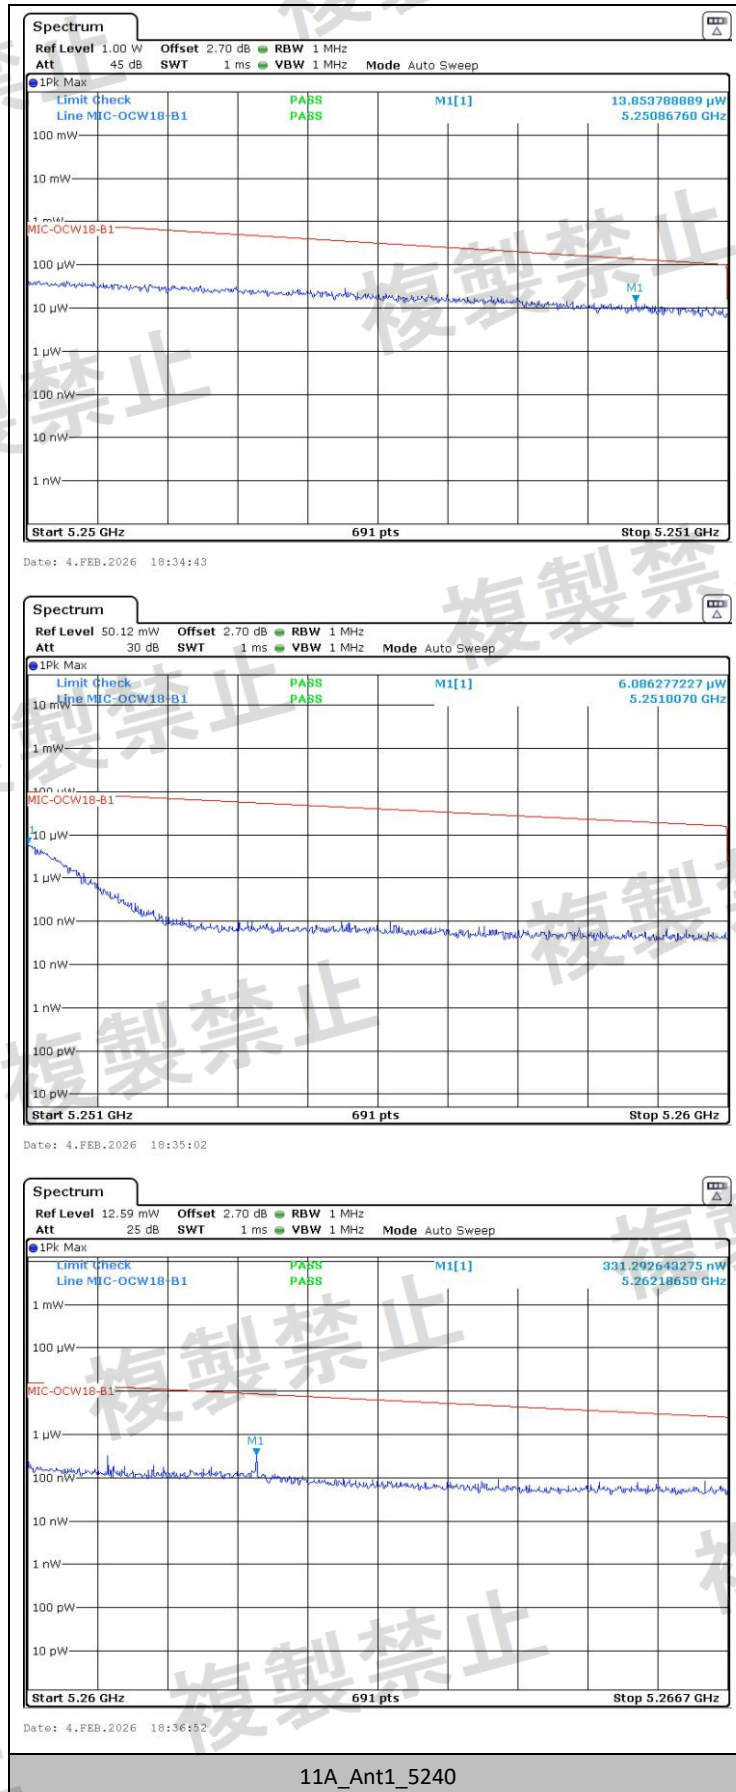


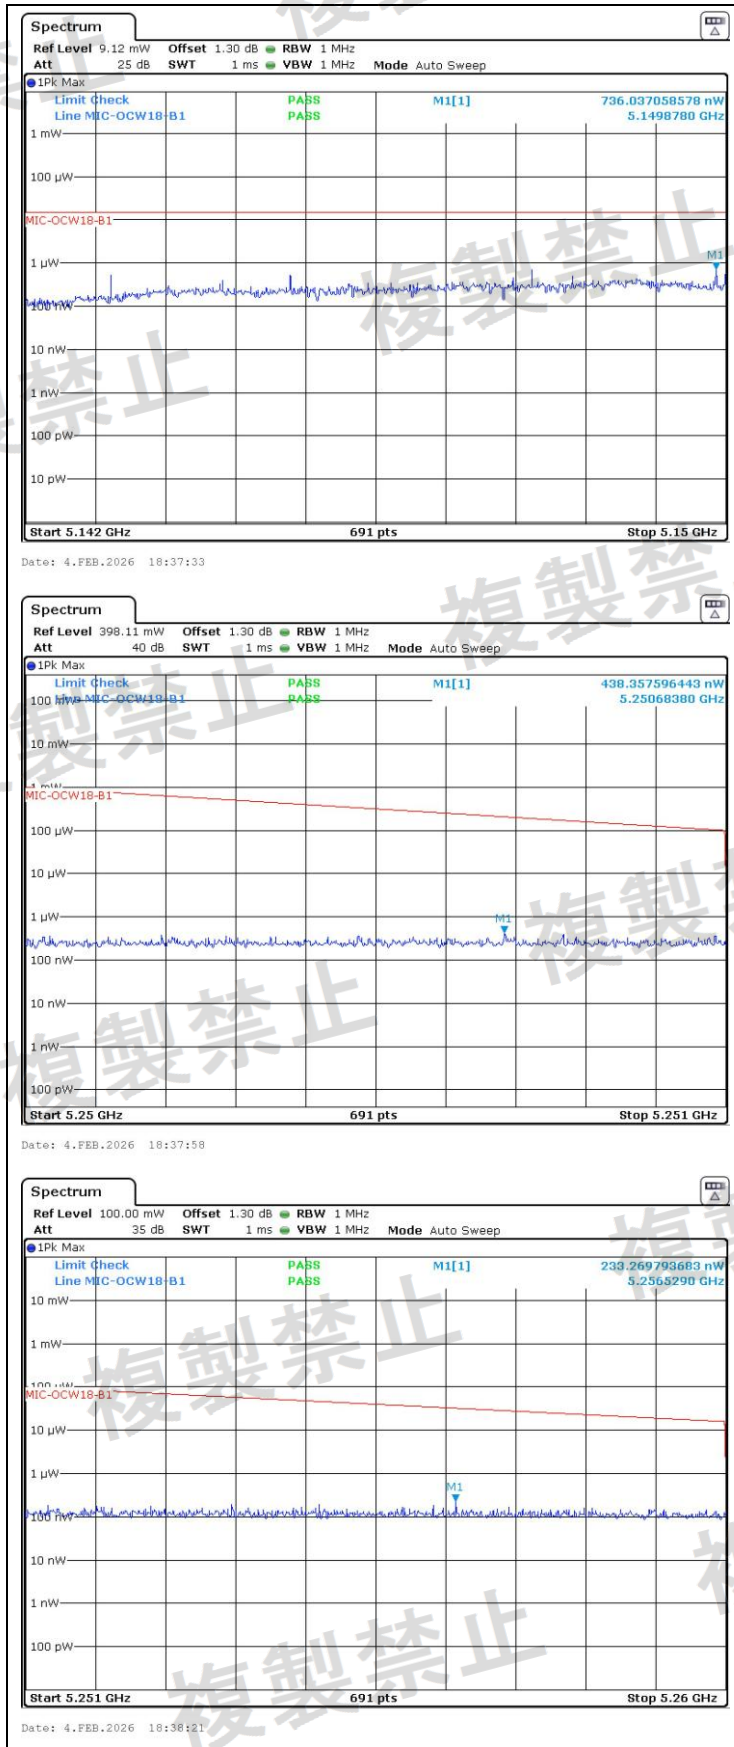

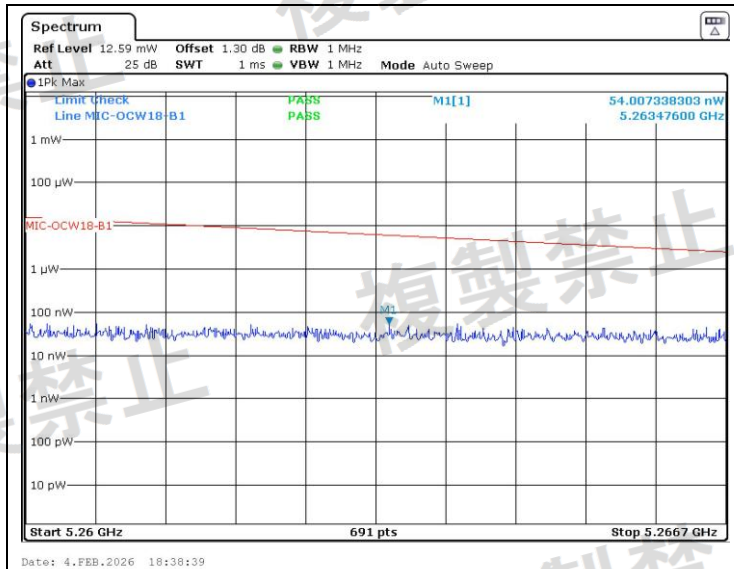


11A_Ant2_5180

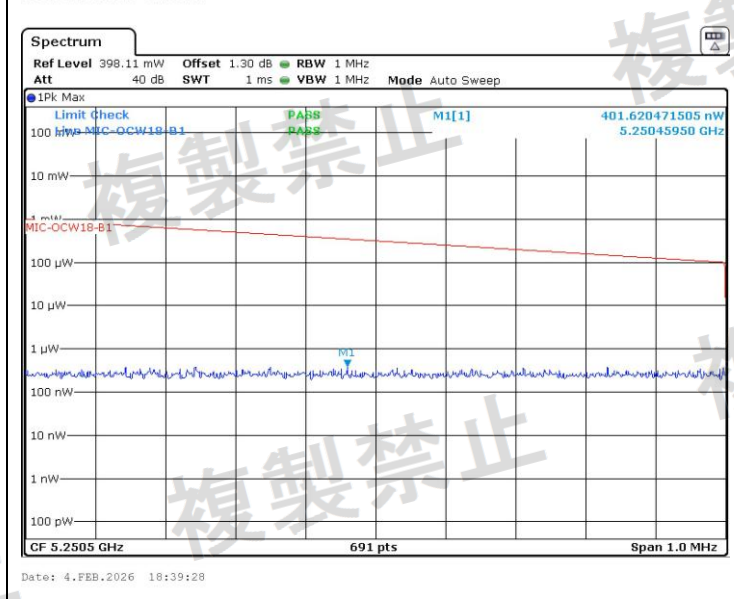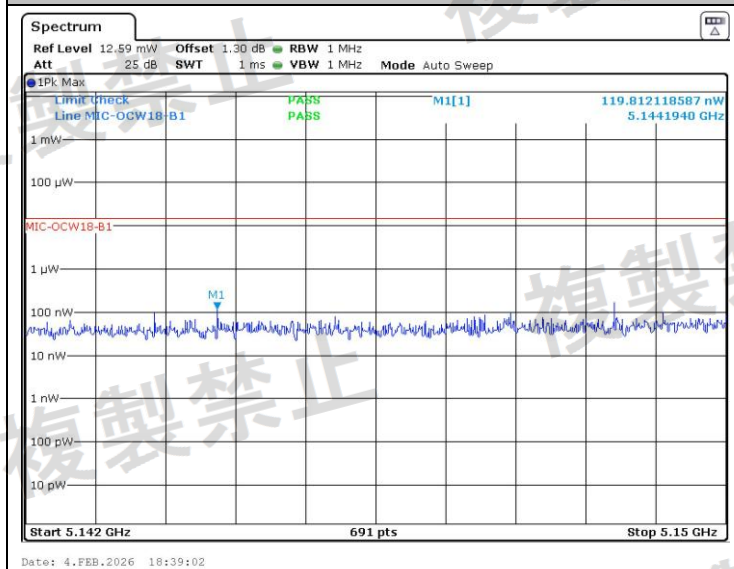

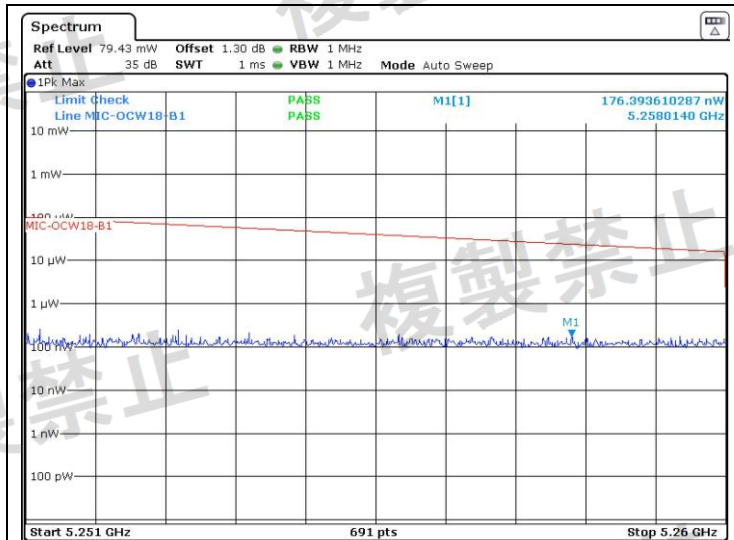


Date: 4.FEB.2026 18:39:58

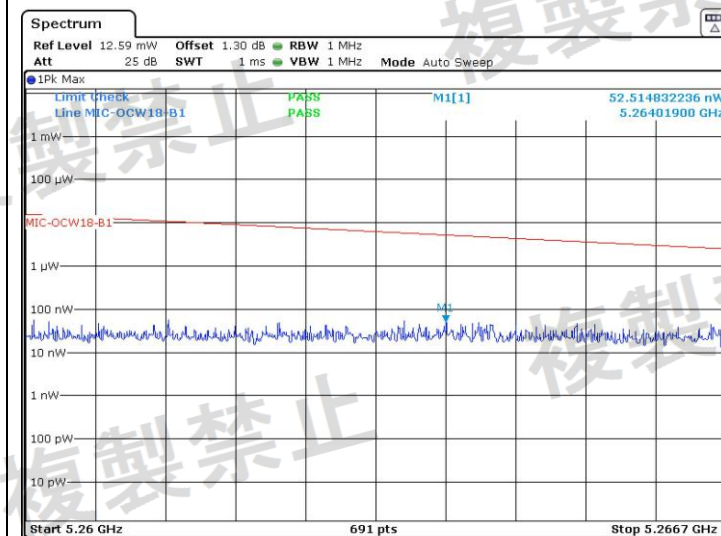


Date: 4.FEB.2026 18:41:03


11A_Ant2_5200

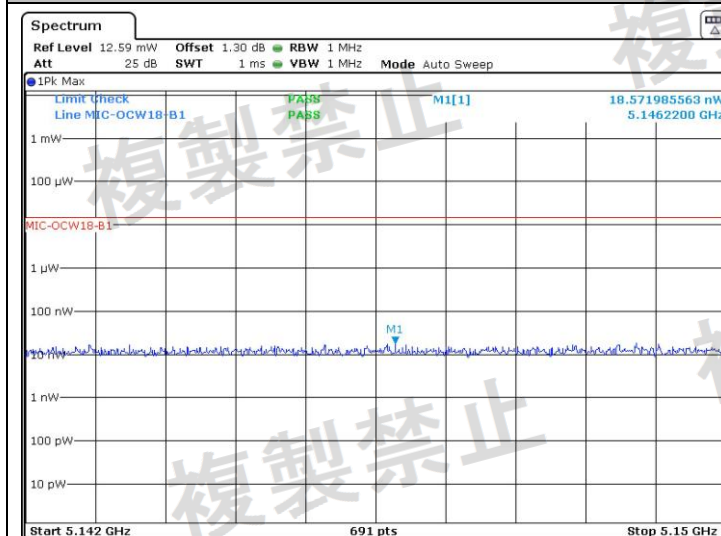



Date: 4.FEB.2026 18:41:36




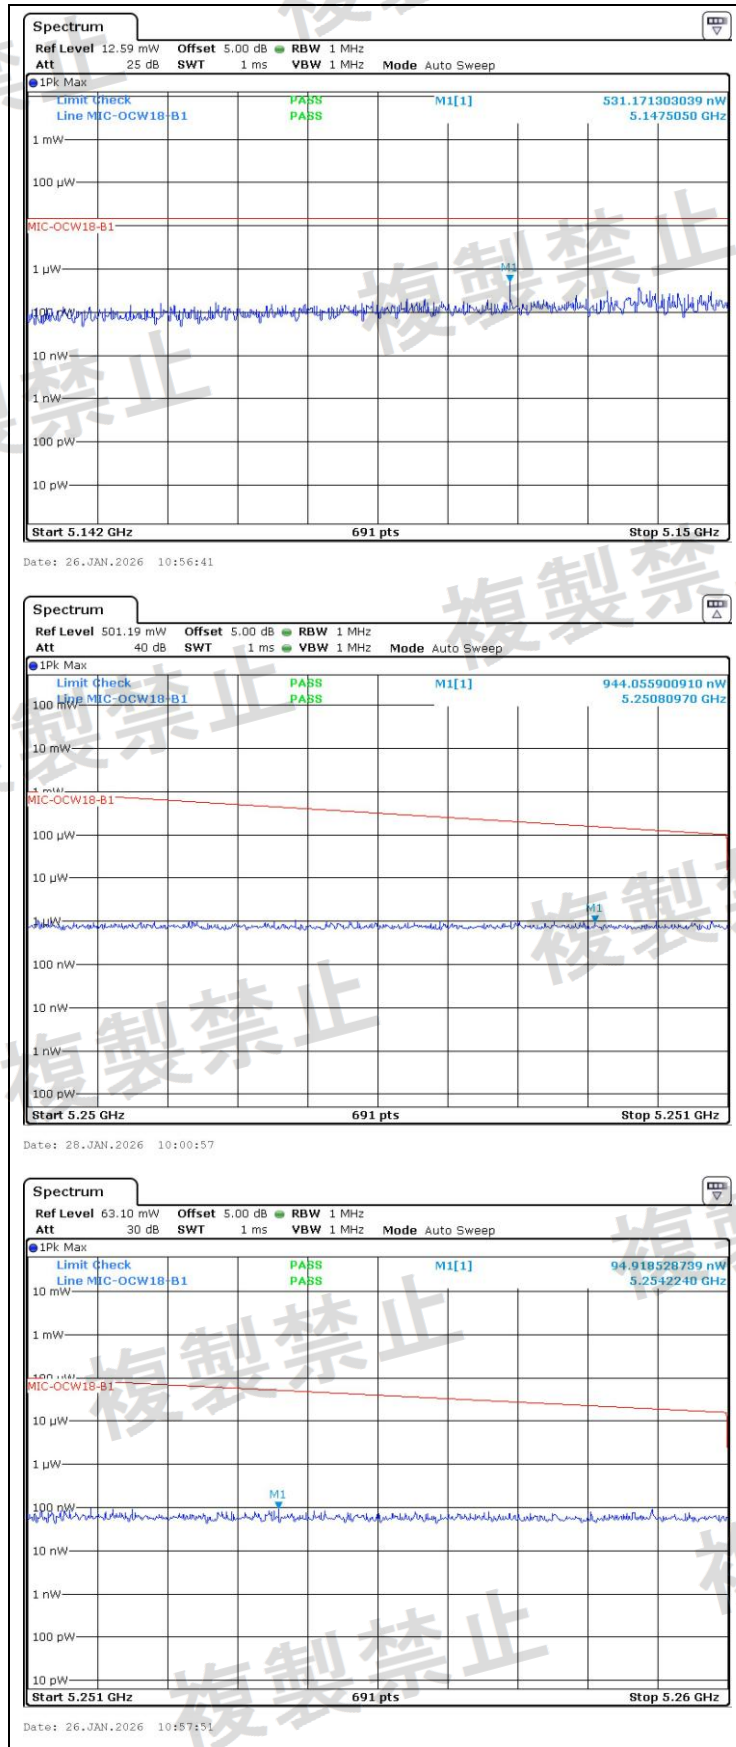

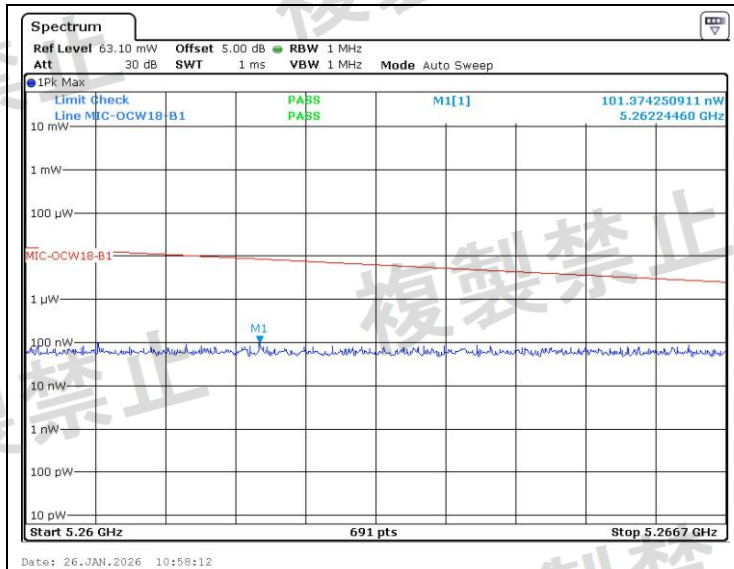


11N20SISO_Ant1_5180

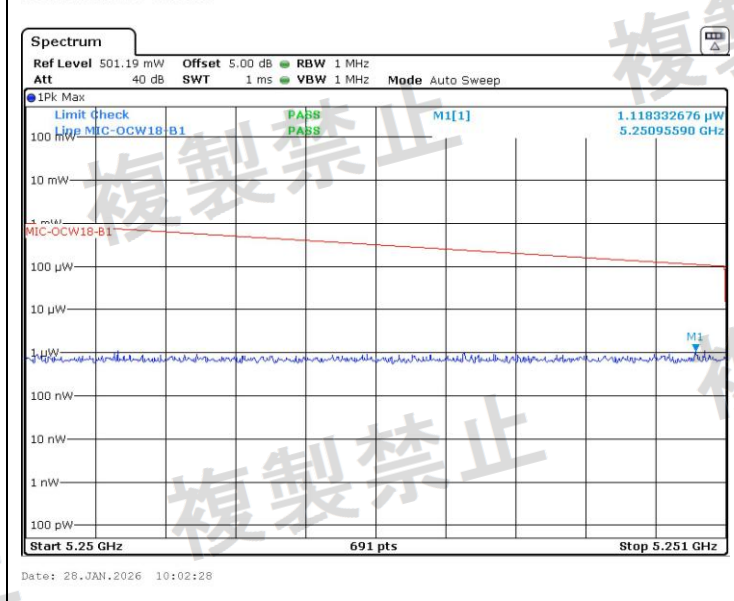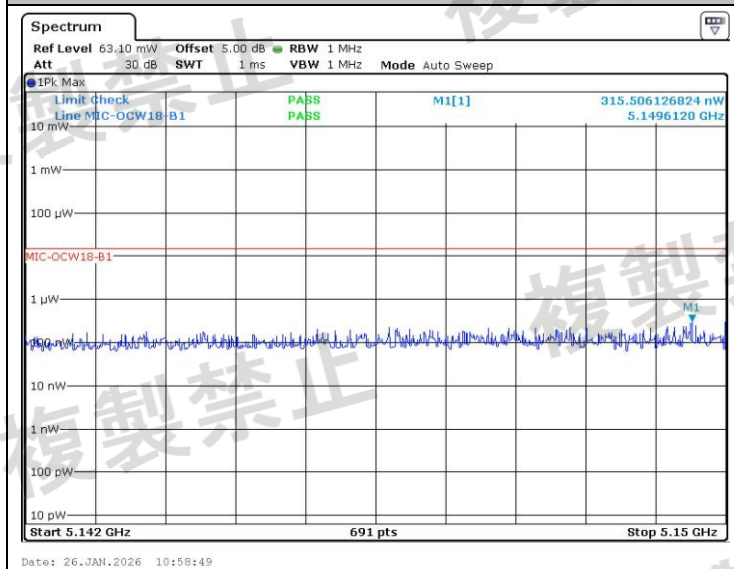

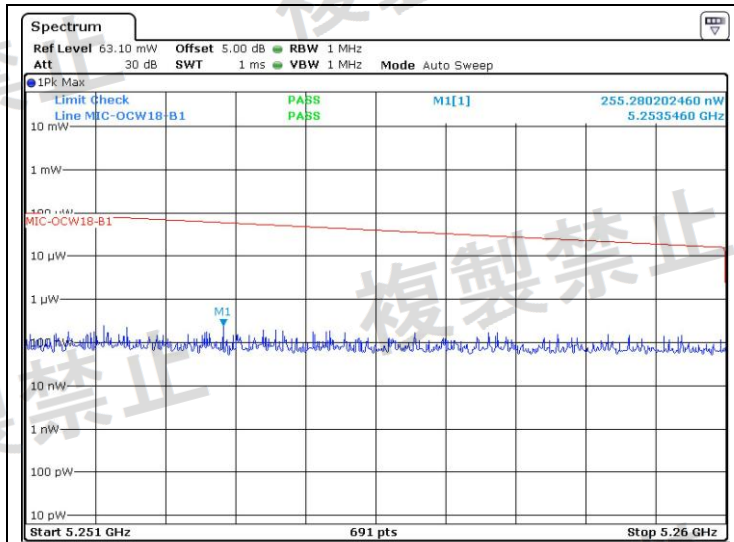


Date: 26.JAN.2026 11:00:53

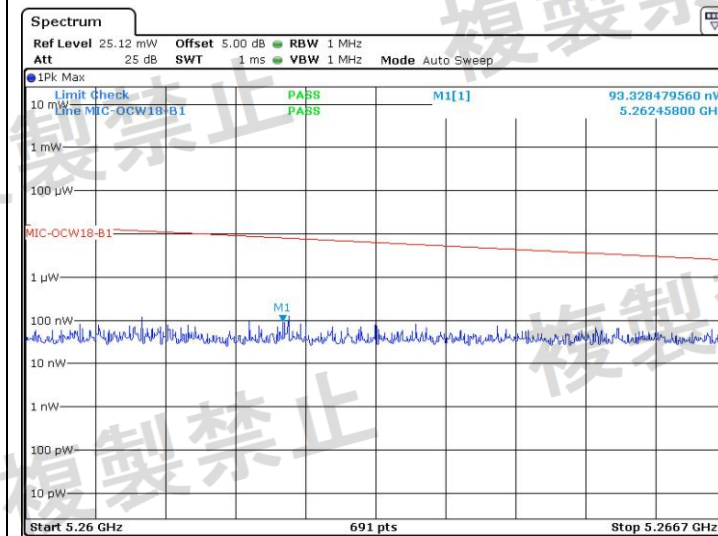



Date: 26.JAN.2026 11:01:16


11N20SISO_Ant1_5200

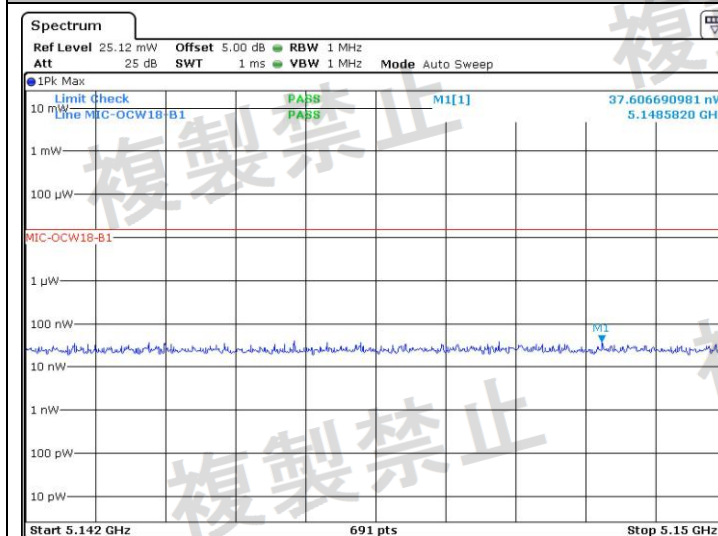



Date: 26.JAN.2026 11:01:52

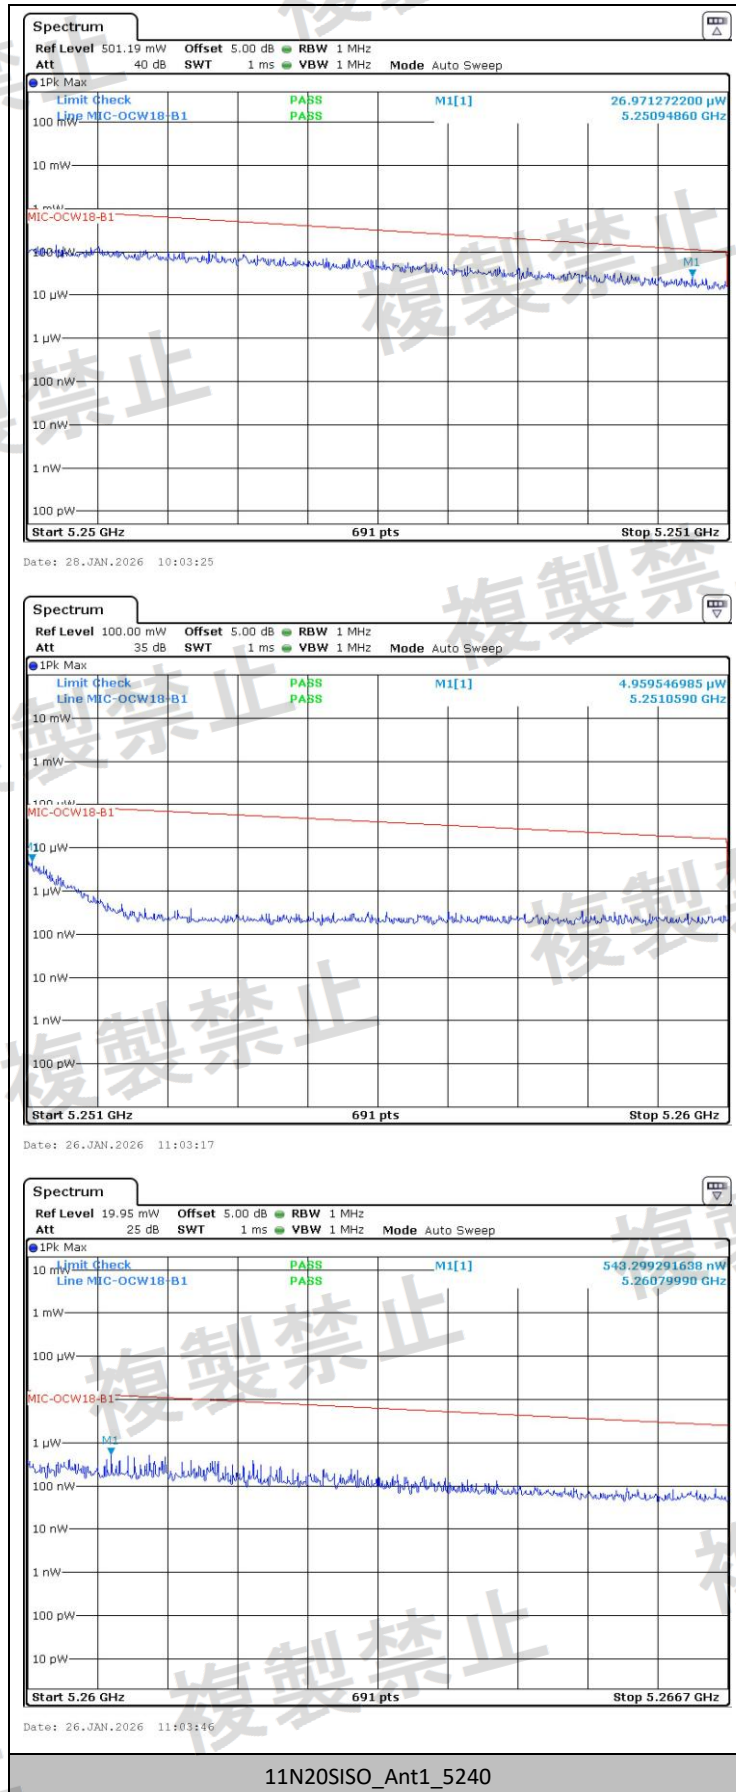


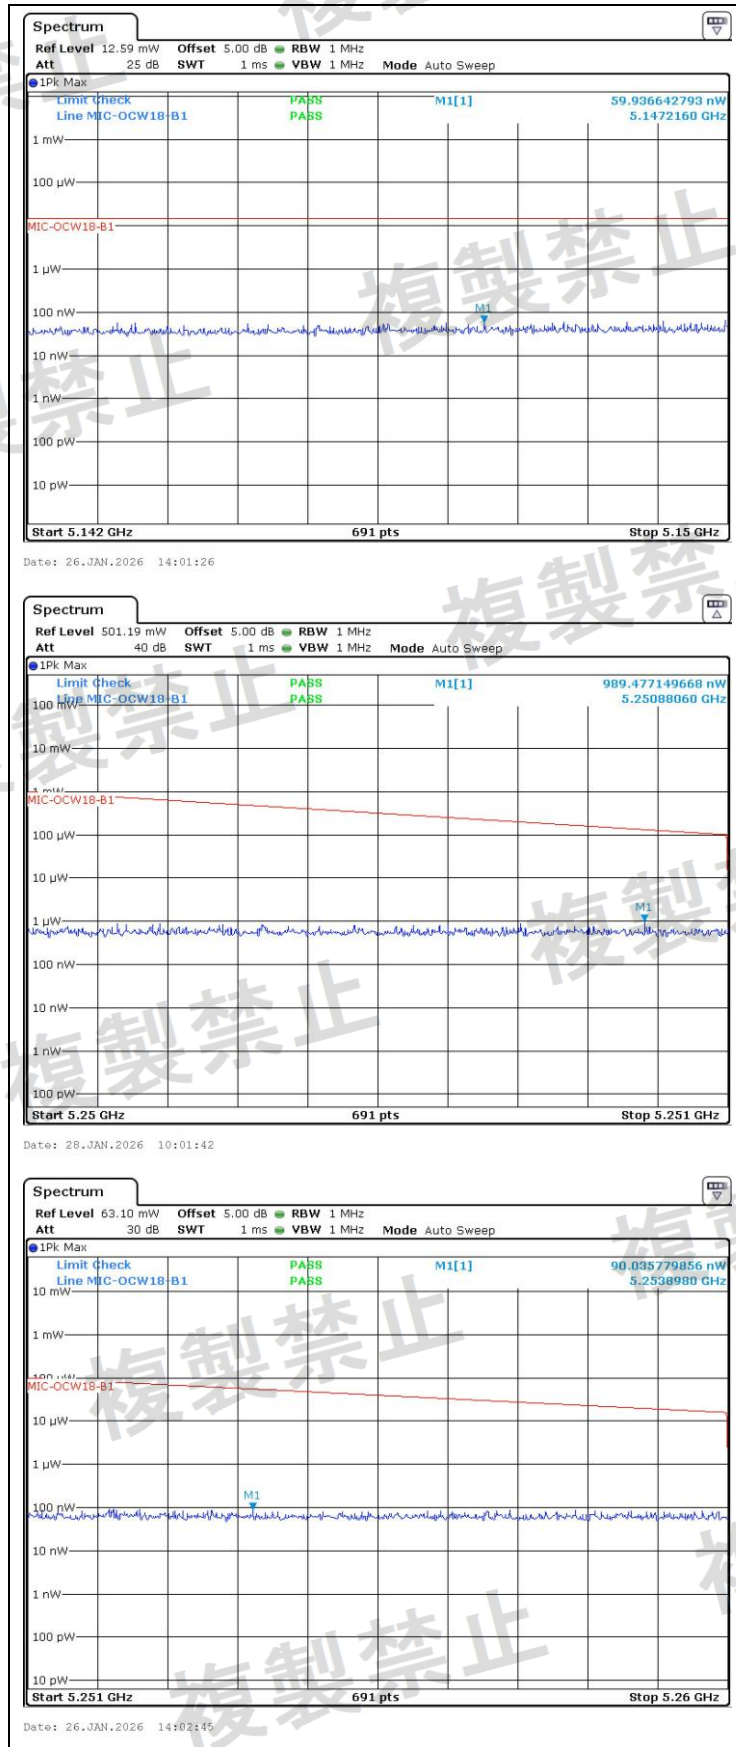


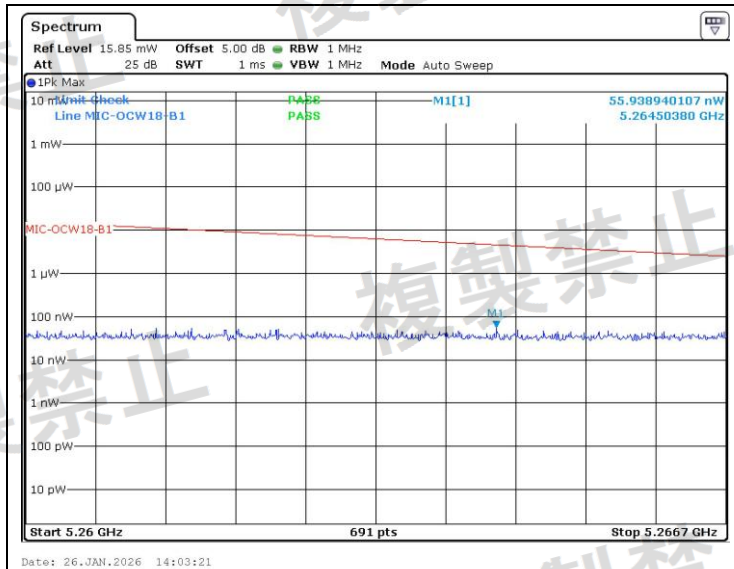



11N20SISO_Ant2_5180

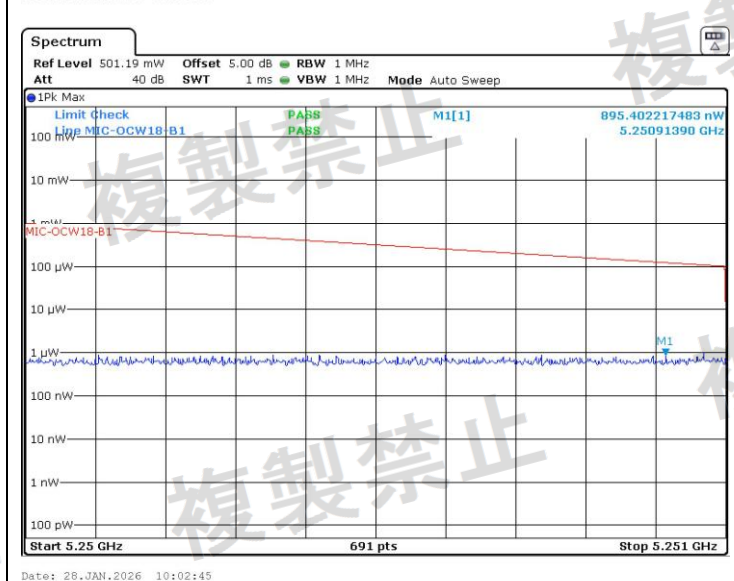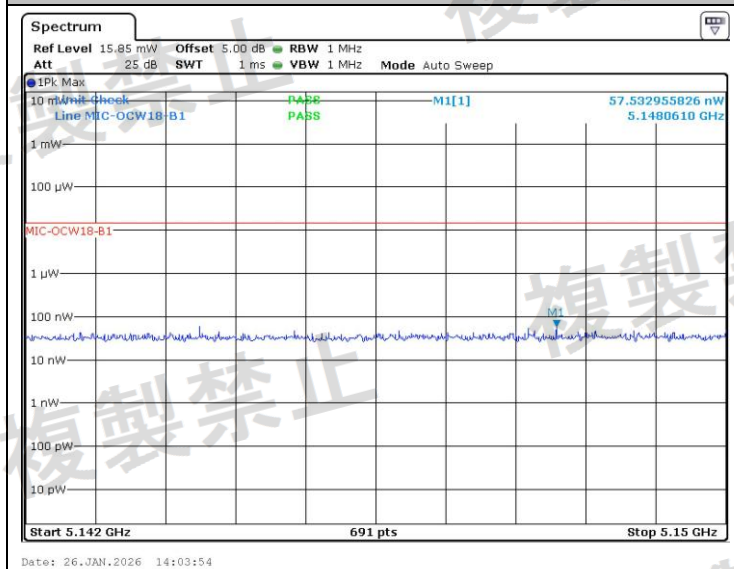


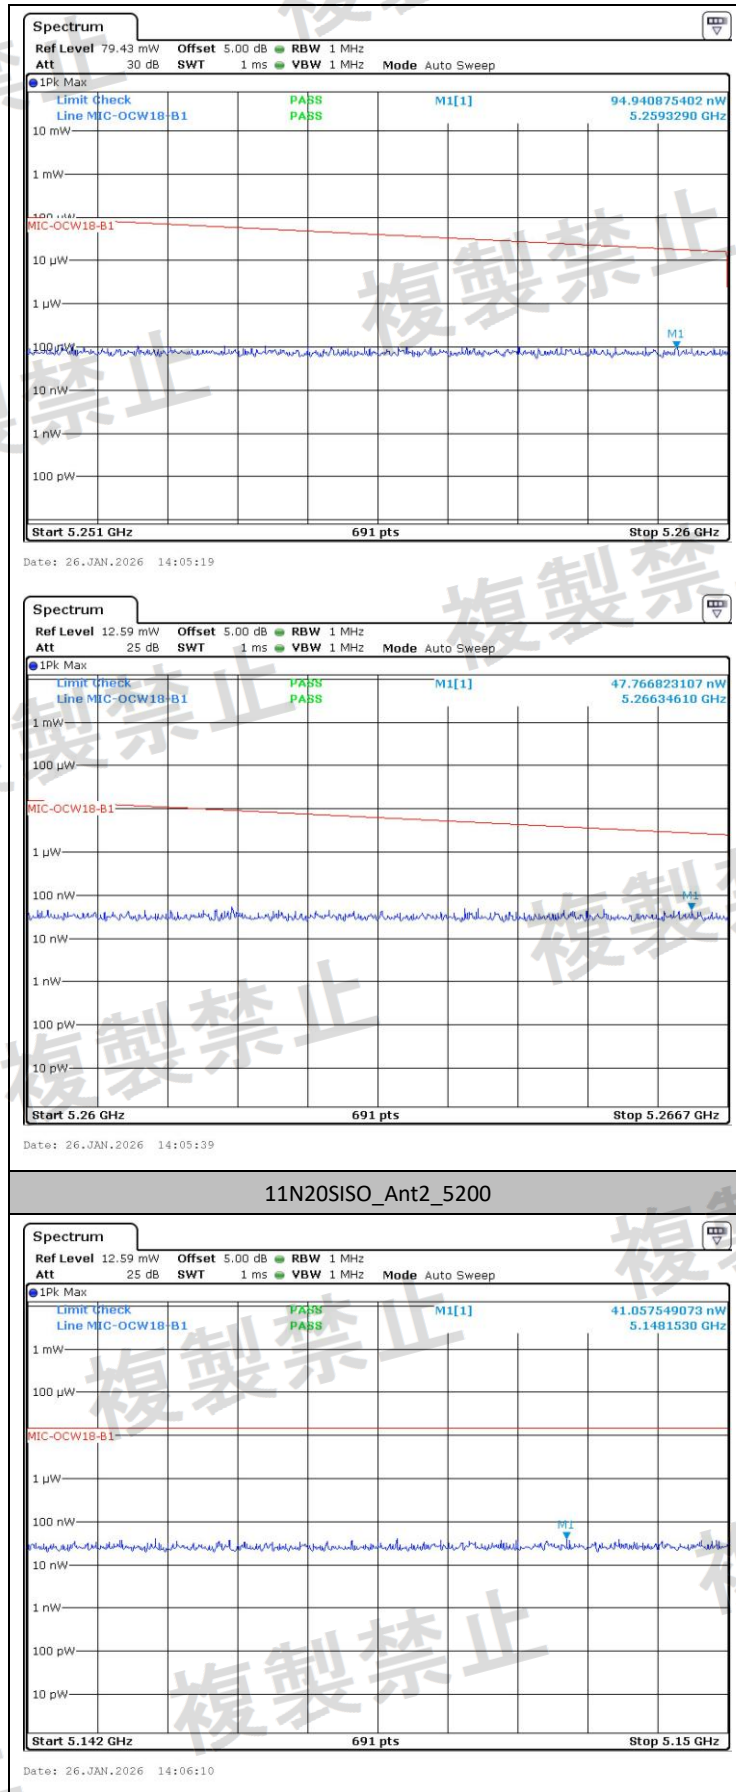


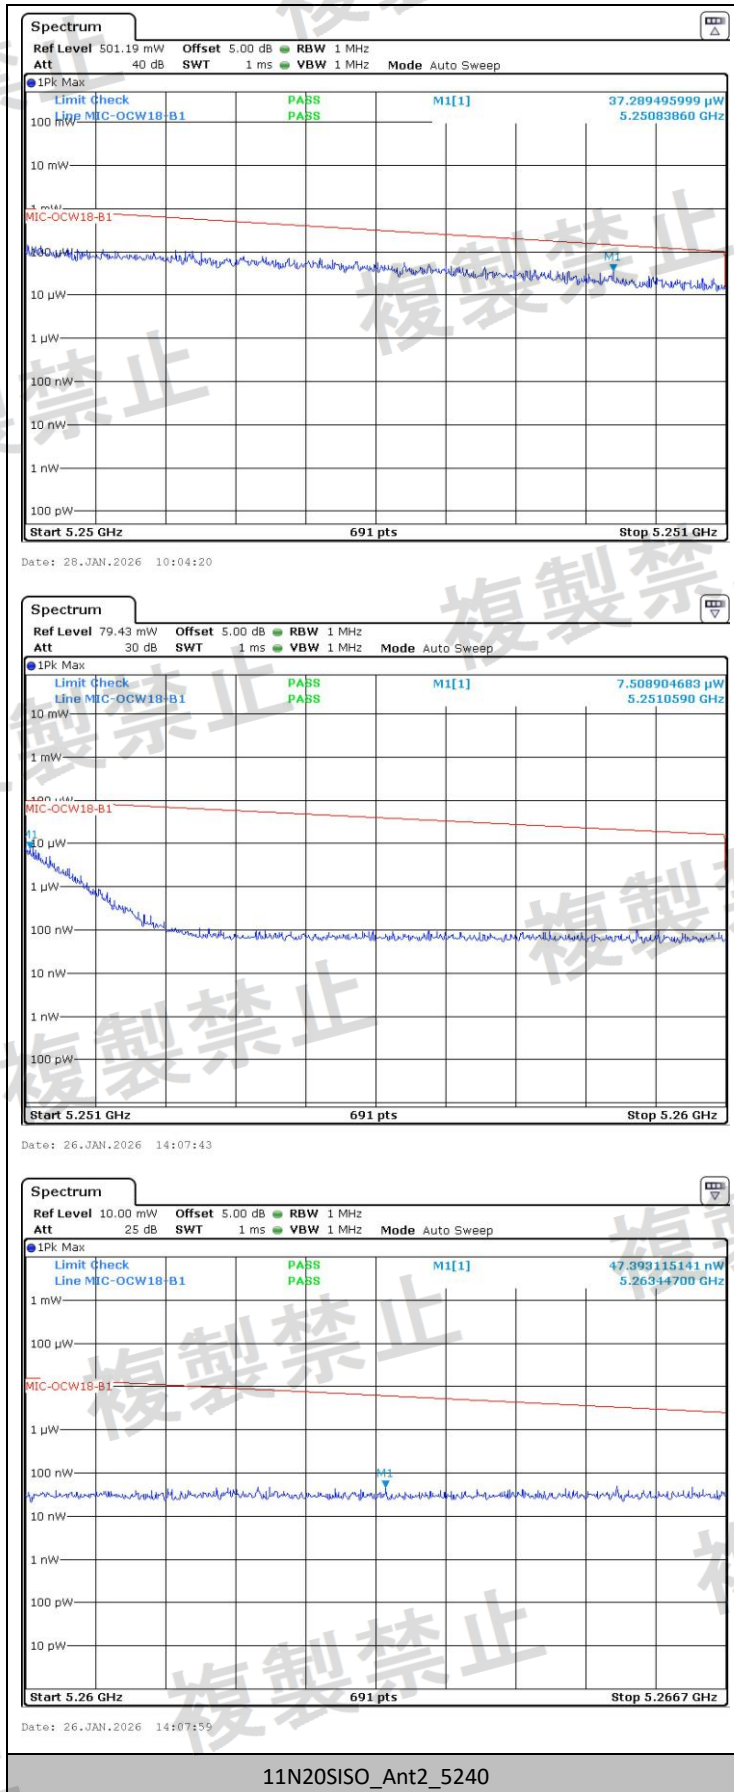


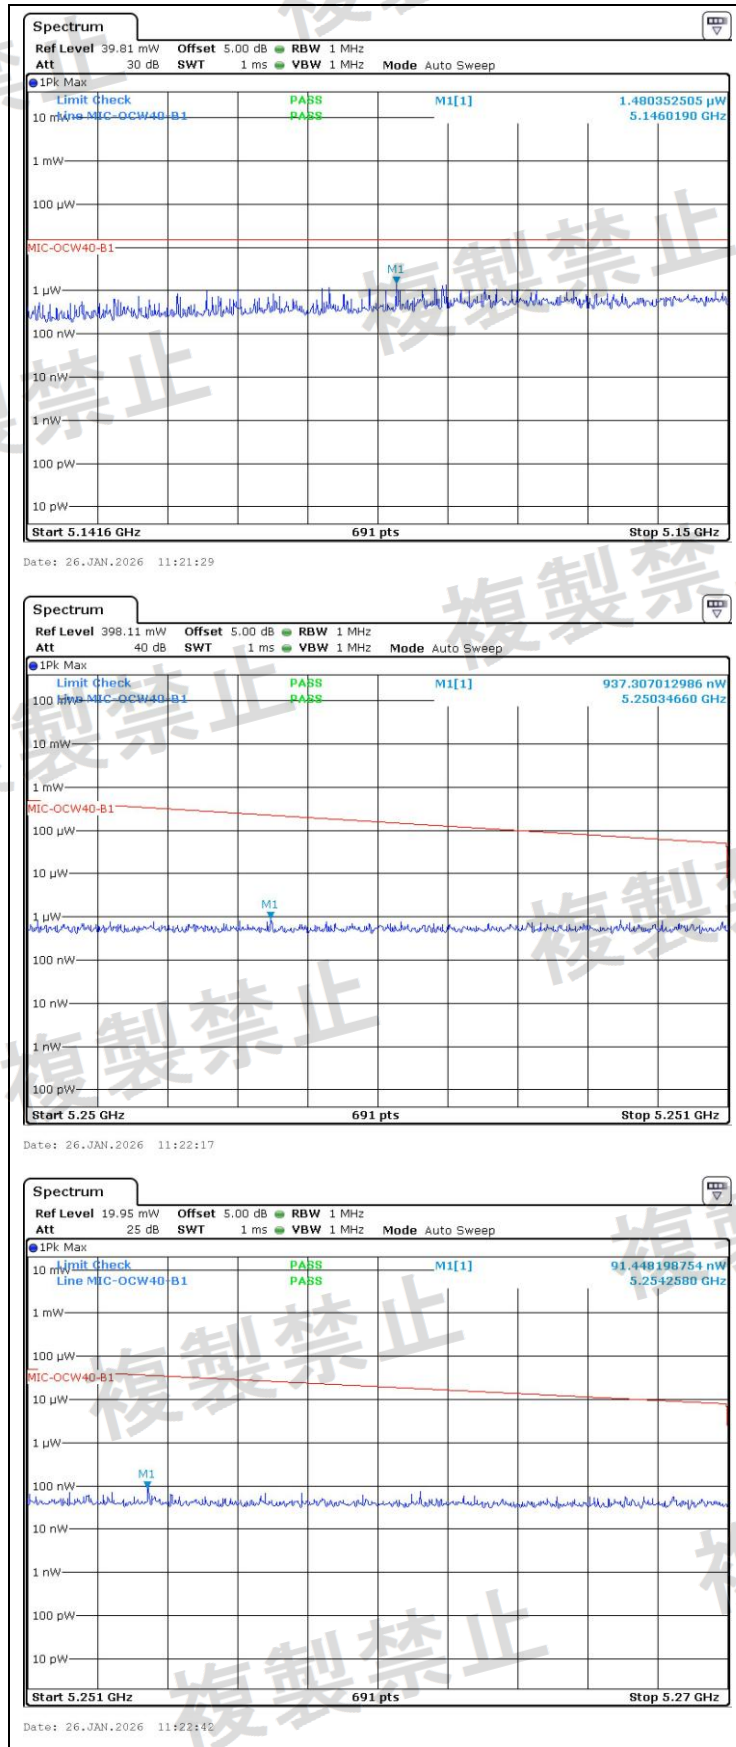


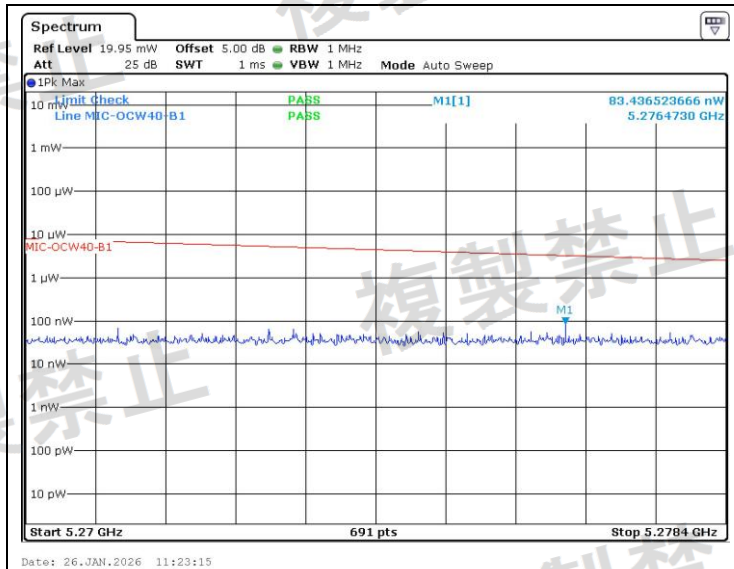



11N40SISO_Ant1_5190

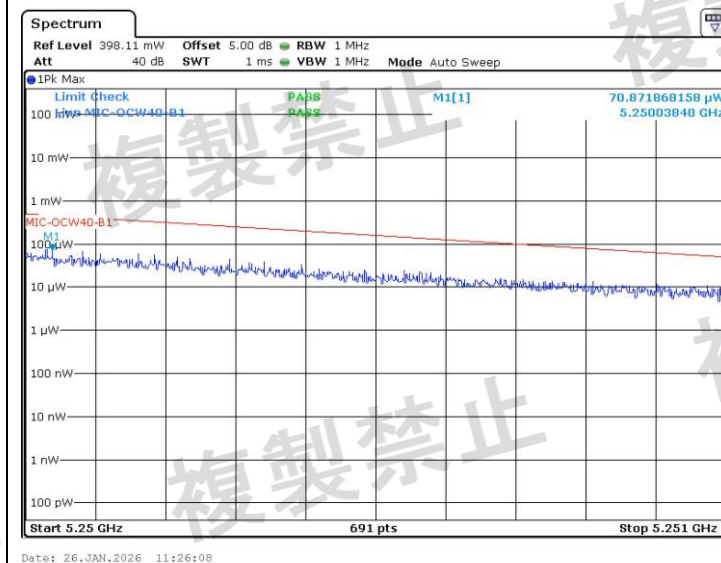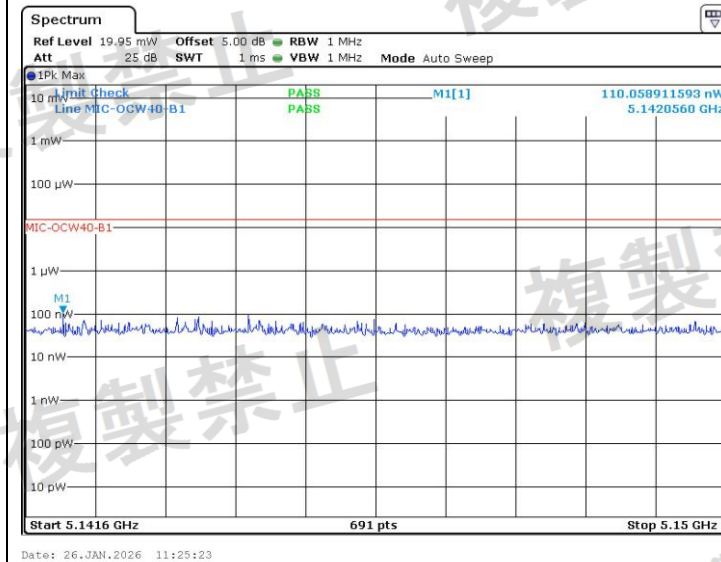


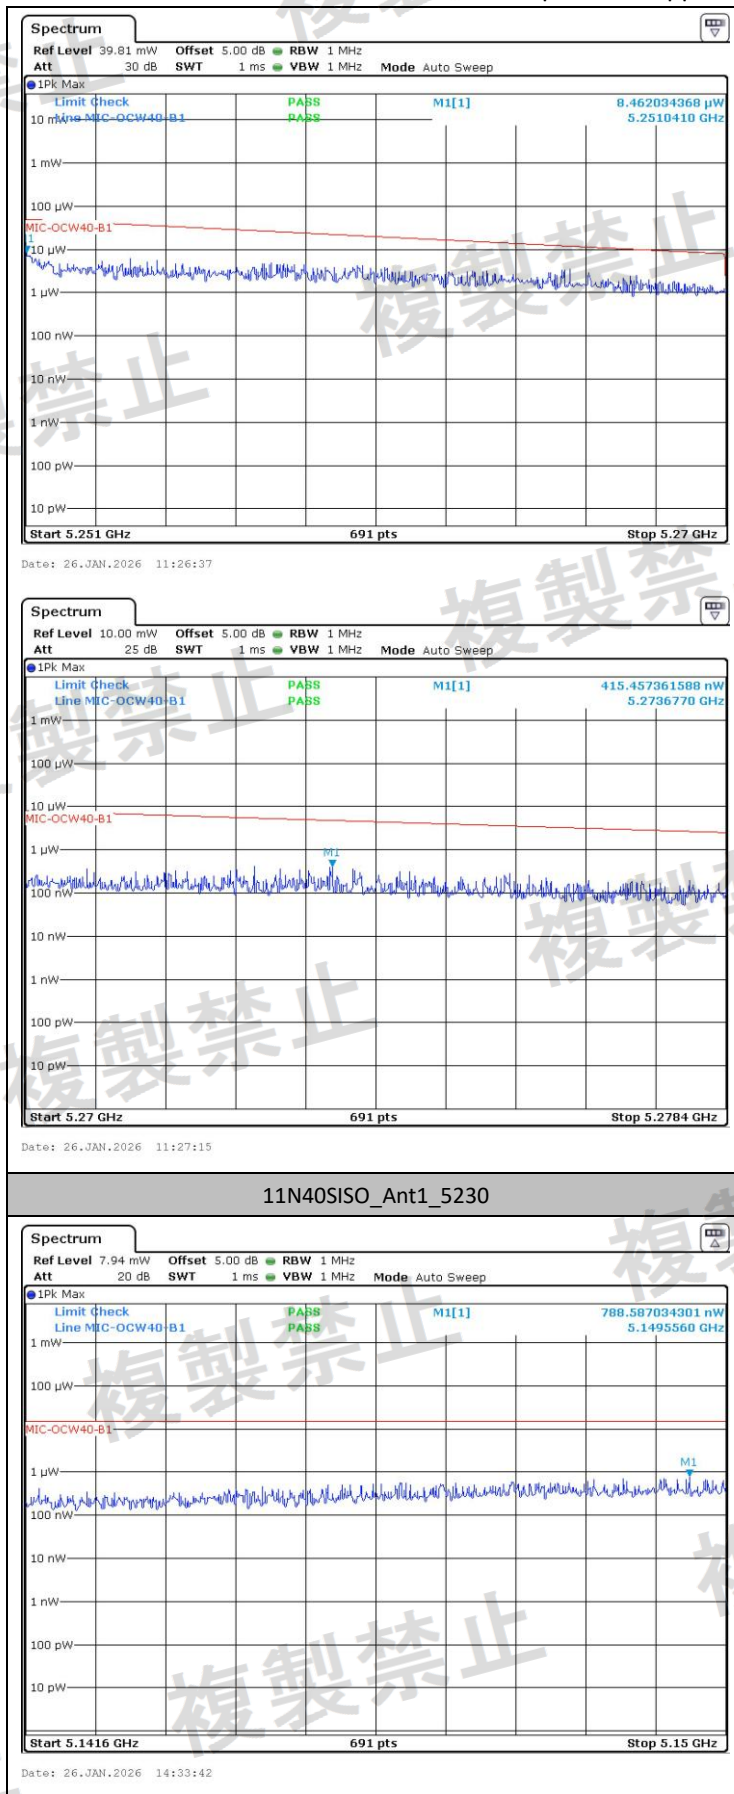



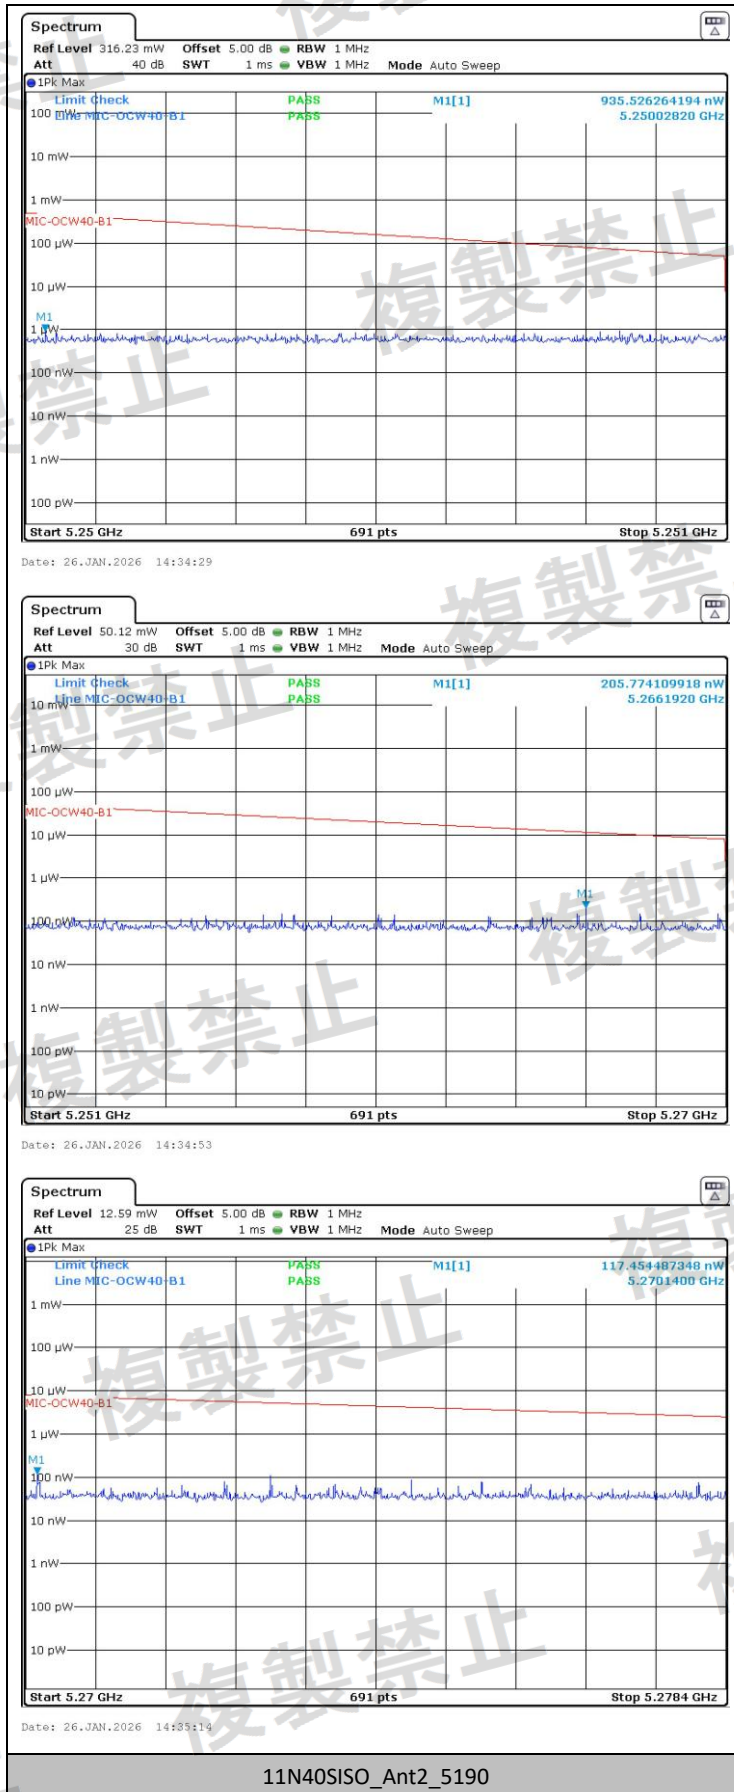


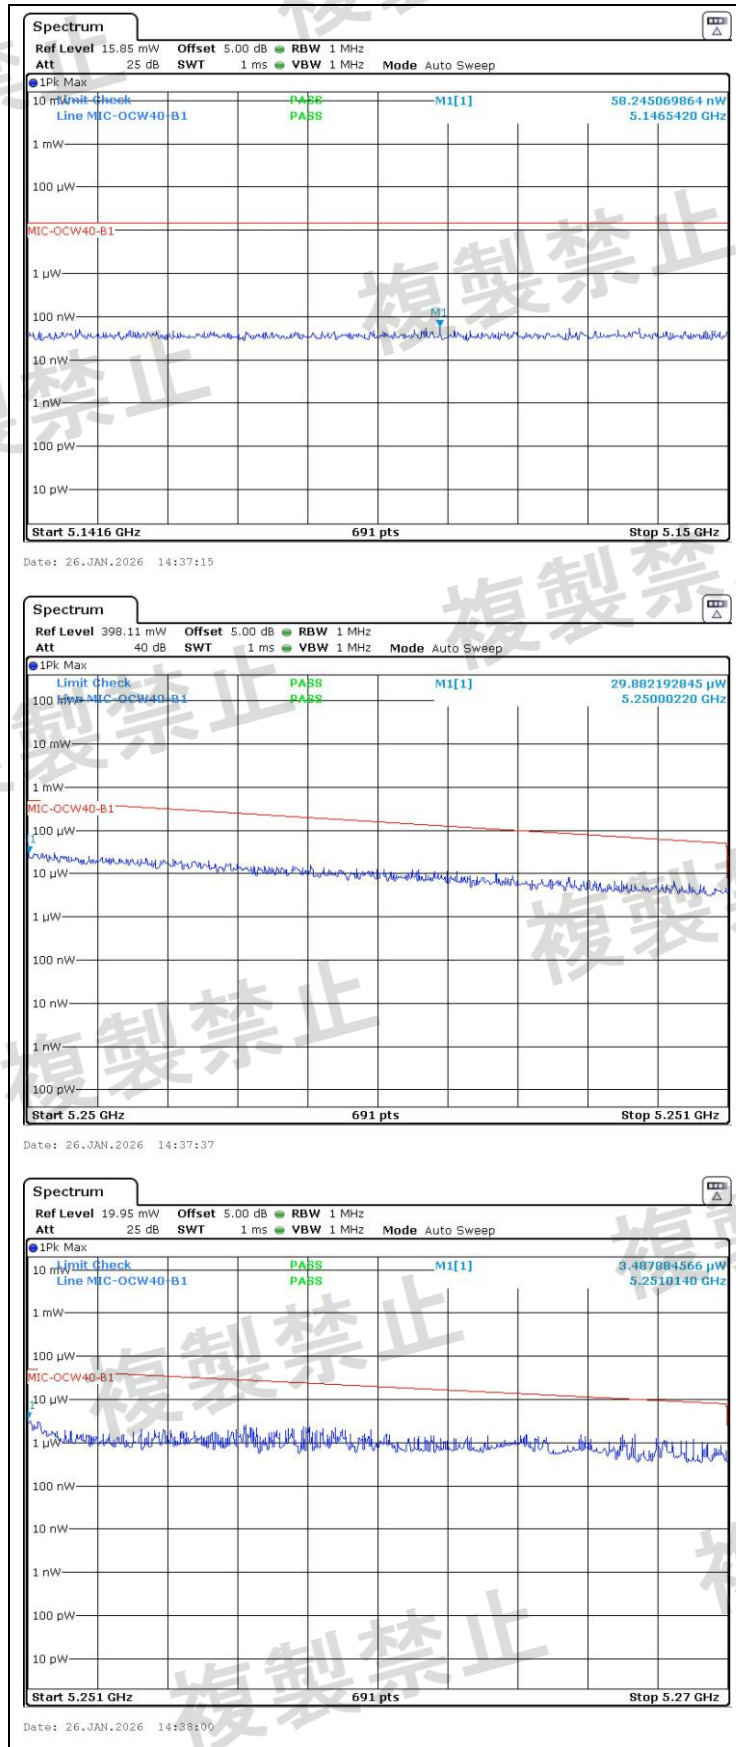

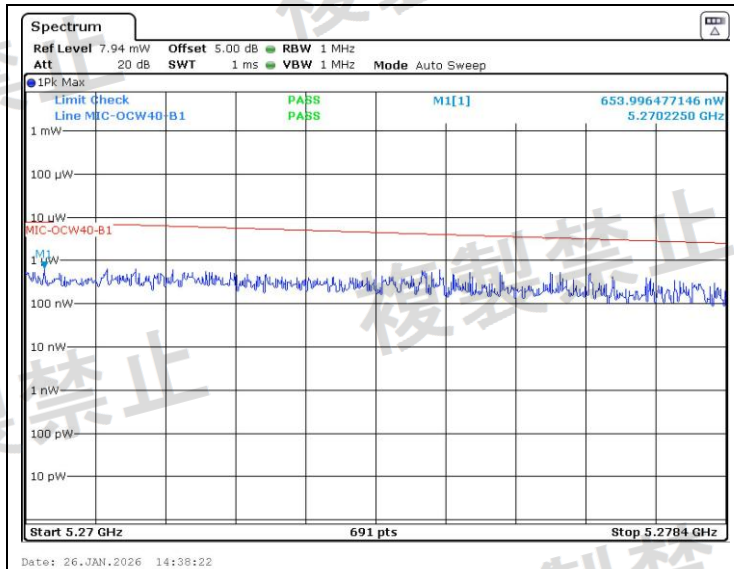



11N40SISO_Ant2_5230

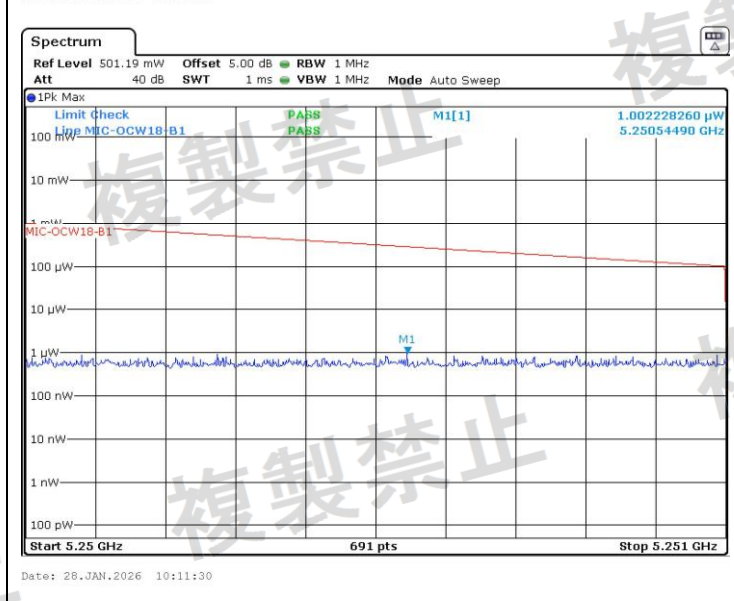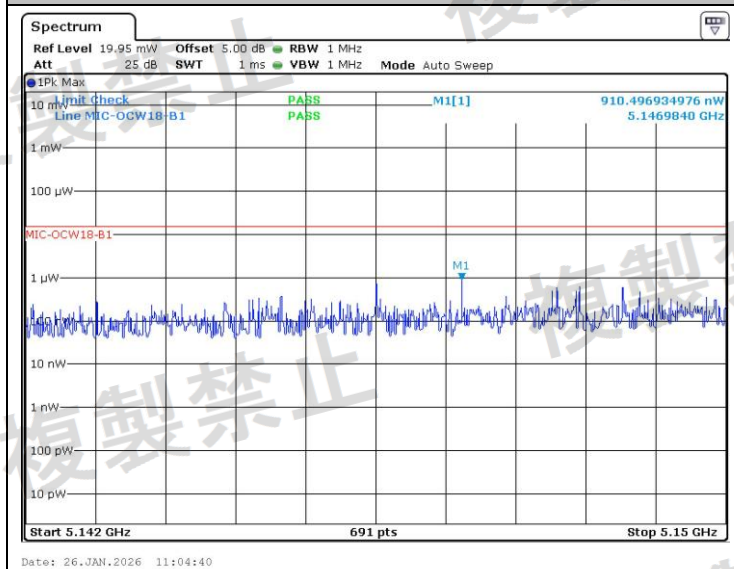


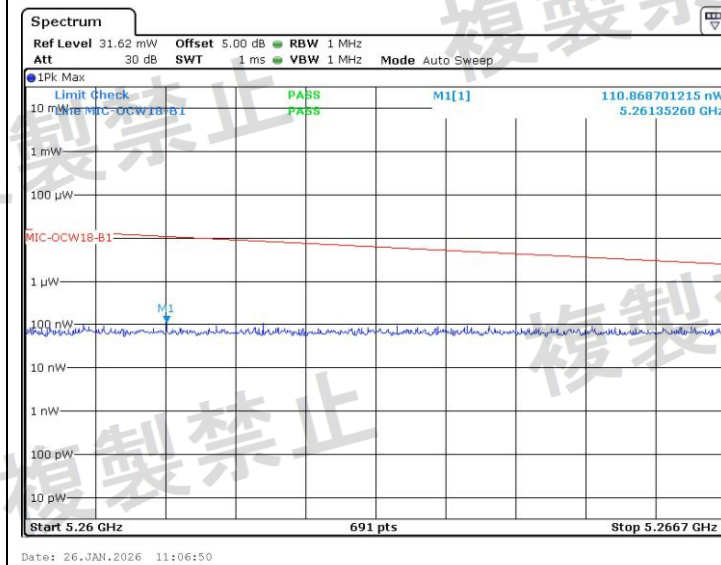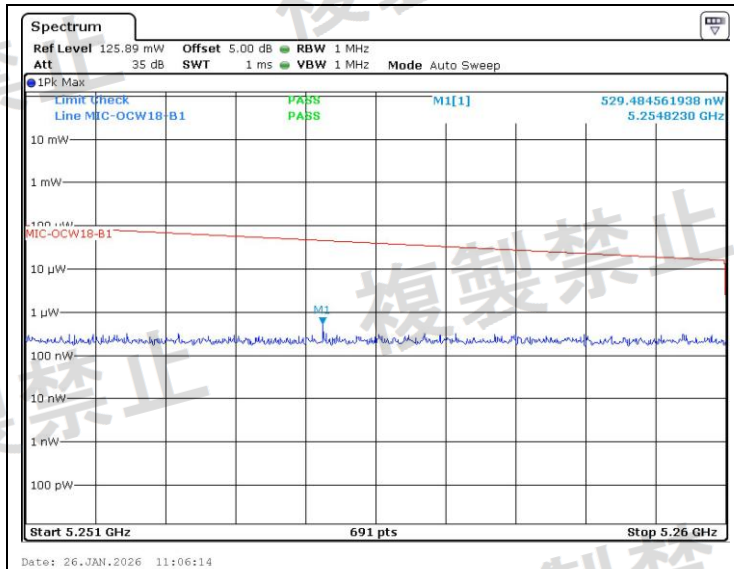


11AC20SISO_Ant1_5180


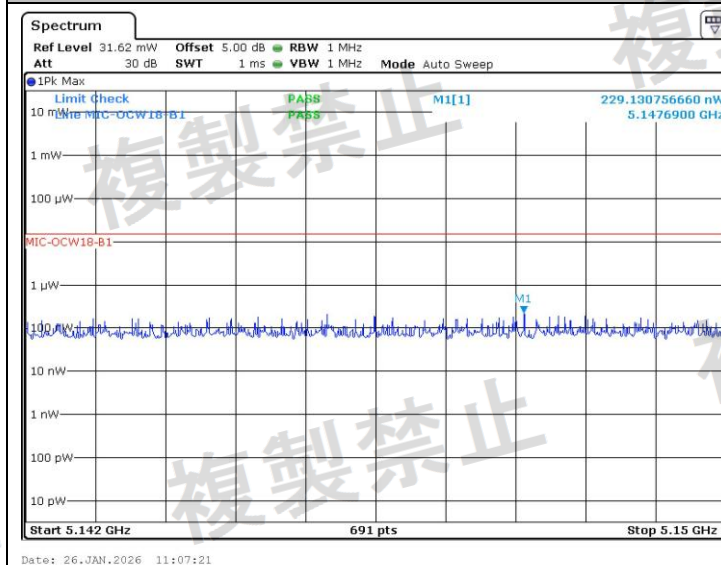


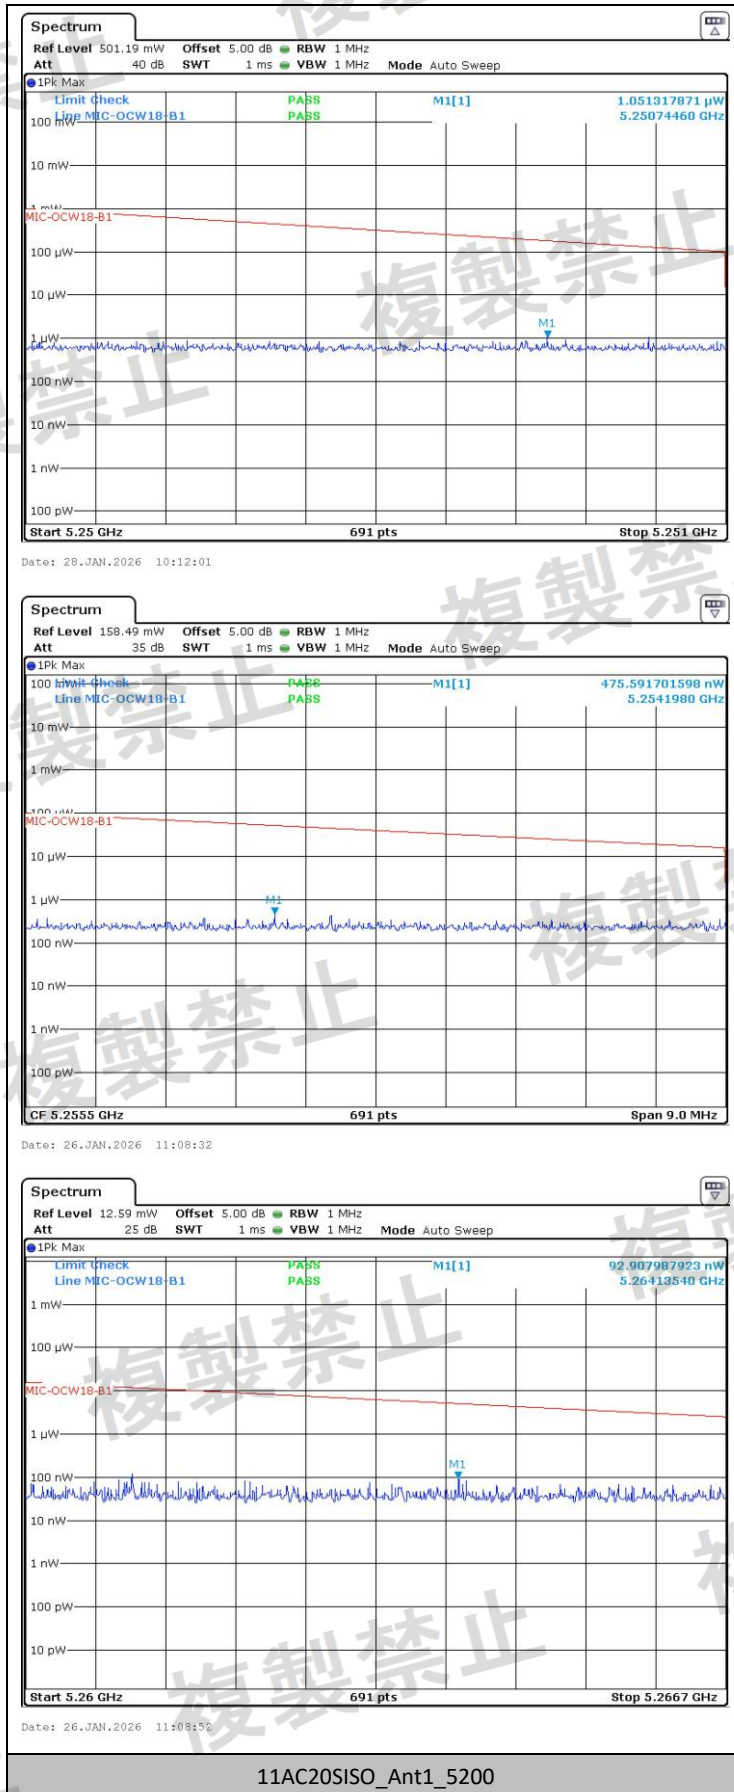


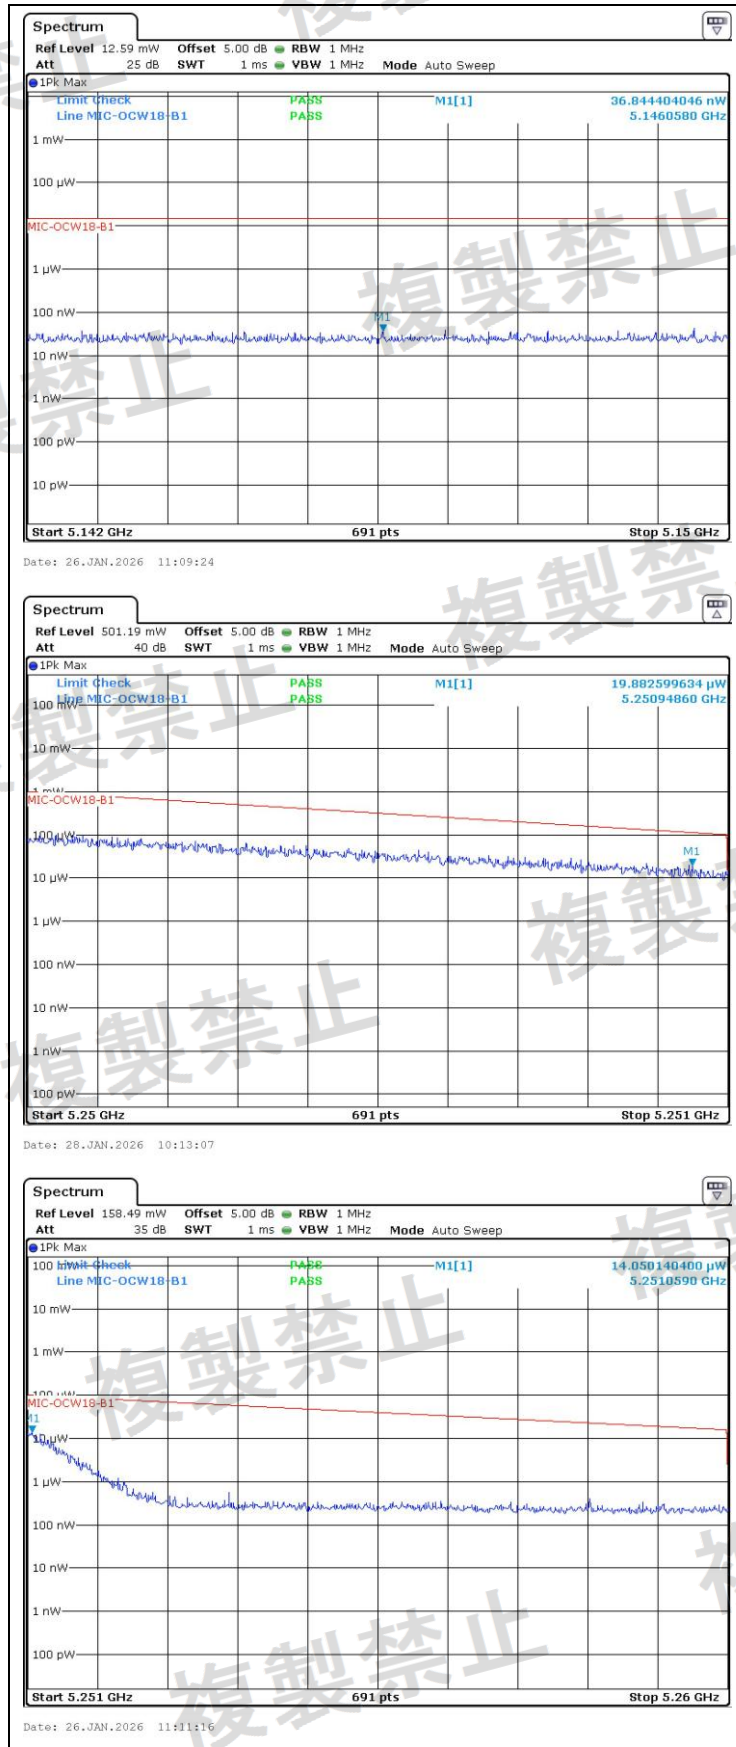

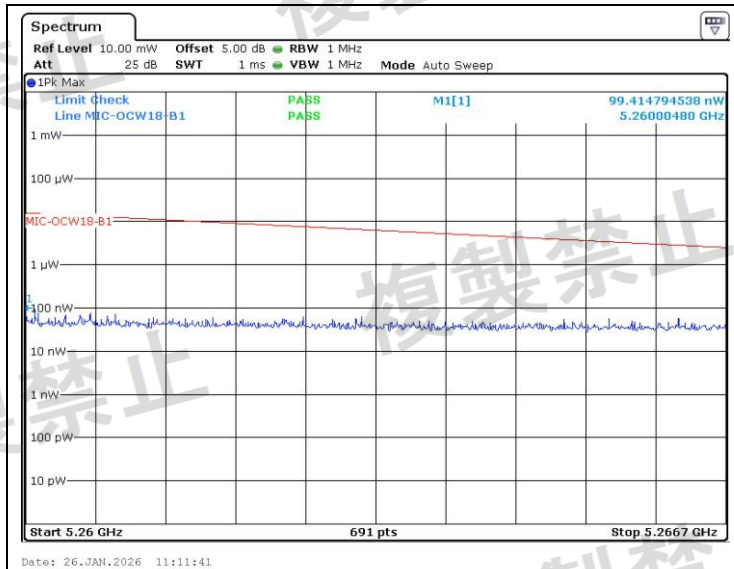


11AC20SISO_Ant1_5240

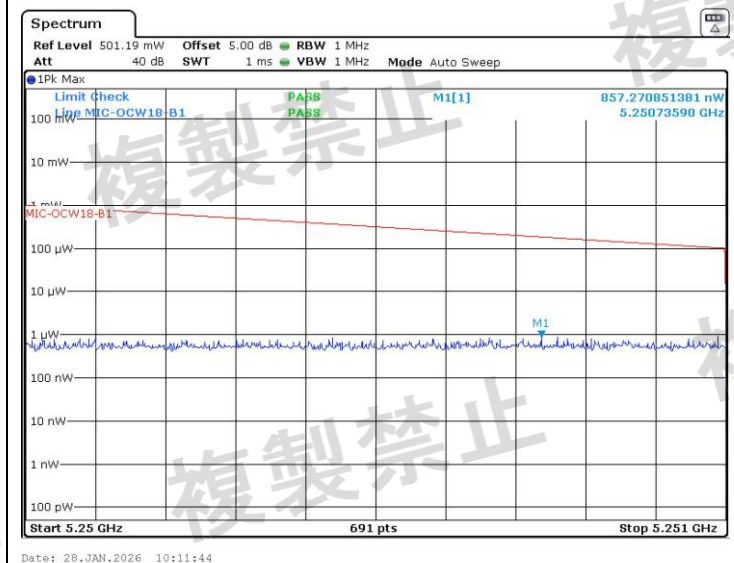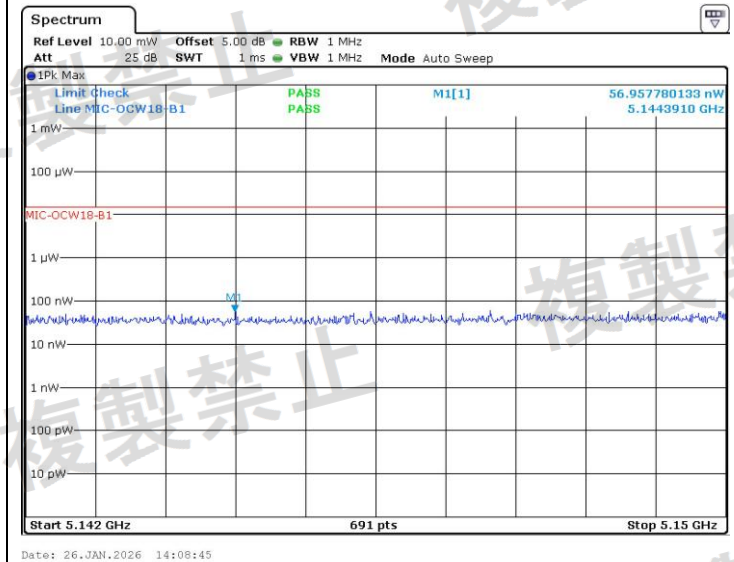

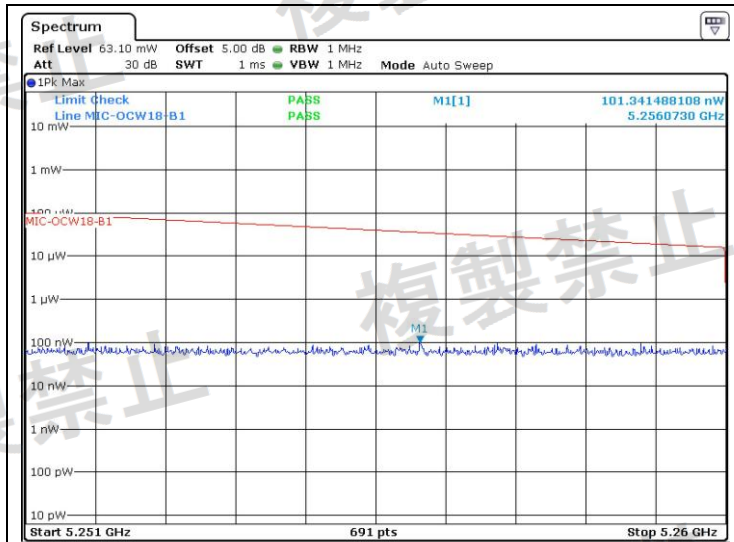


Date: 26.JAN.2026 14:09:57

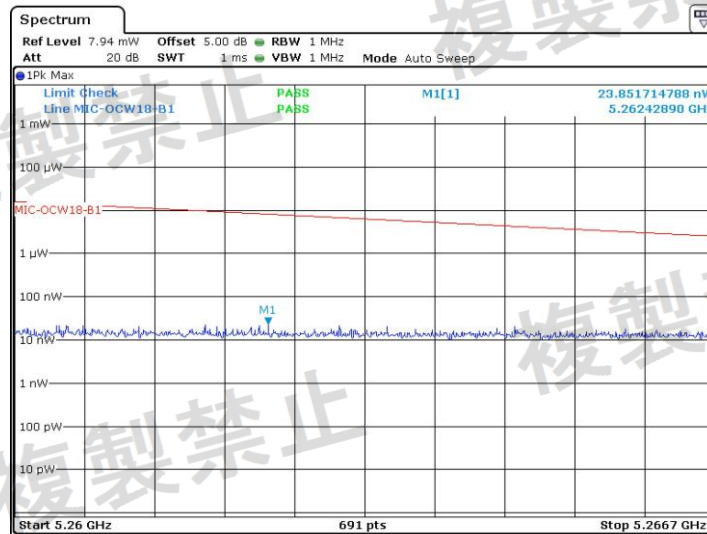



Date: 26.JAN.2026 14:10:16


11AC20SISO_Ant2_5180

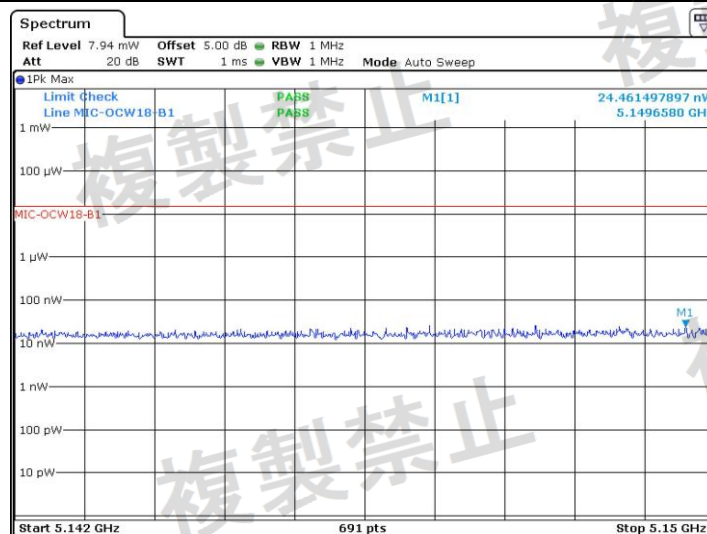



Date: 26.JAN.2026 14:10:54

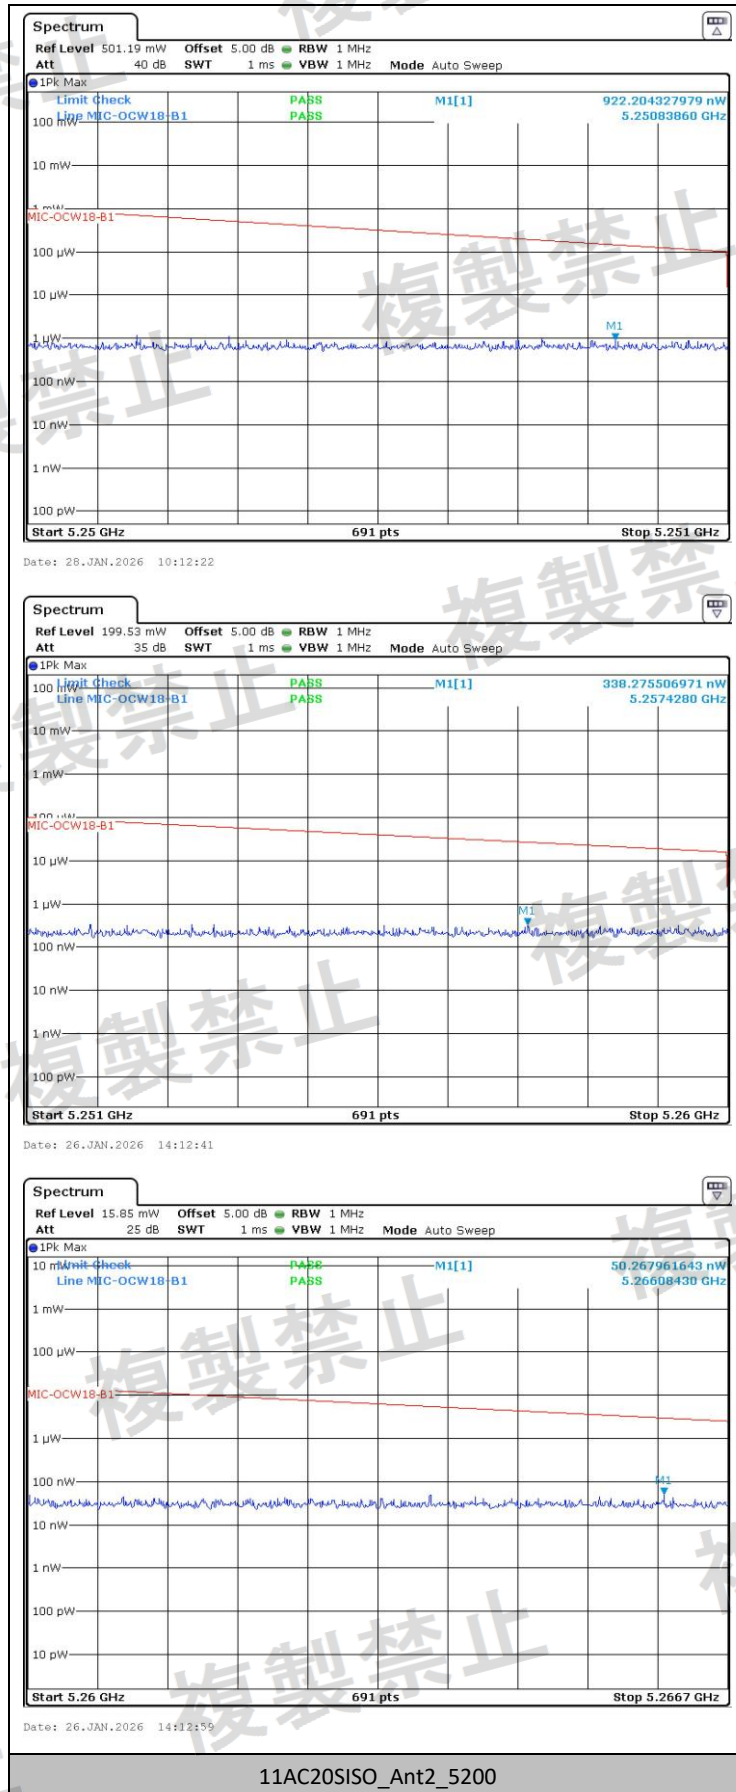


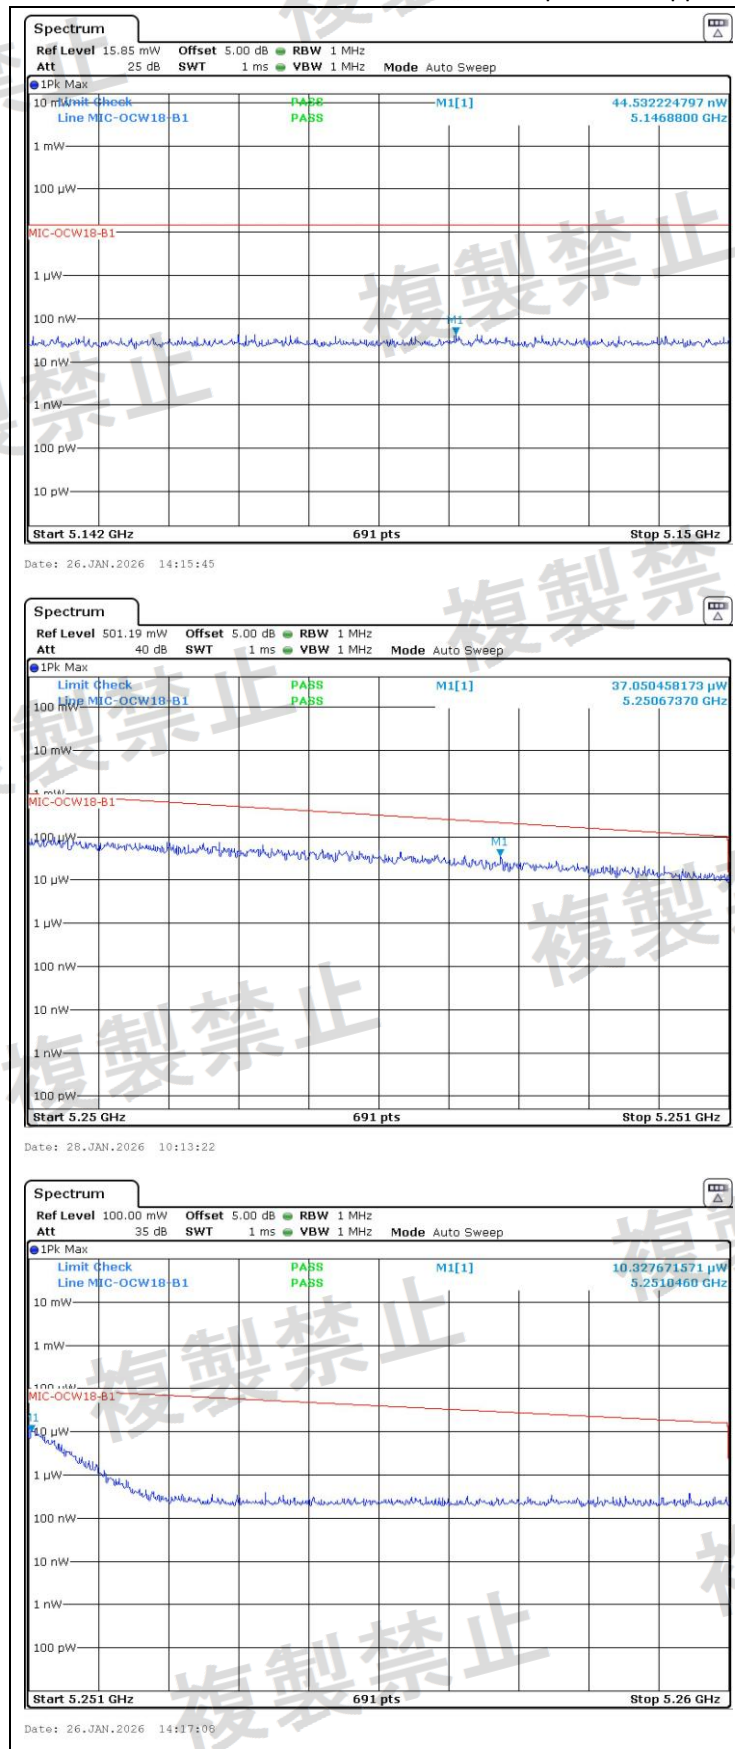

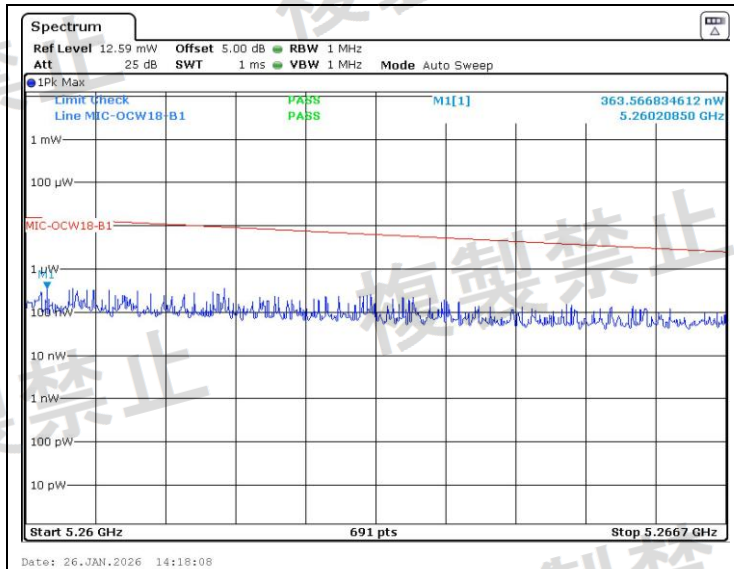


11AC20SISO_Ant2_5240

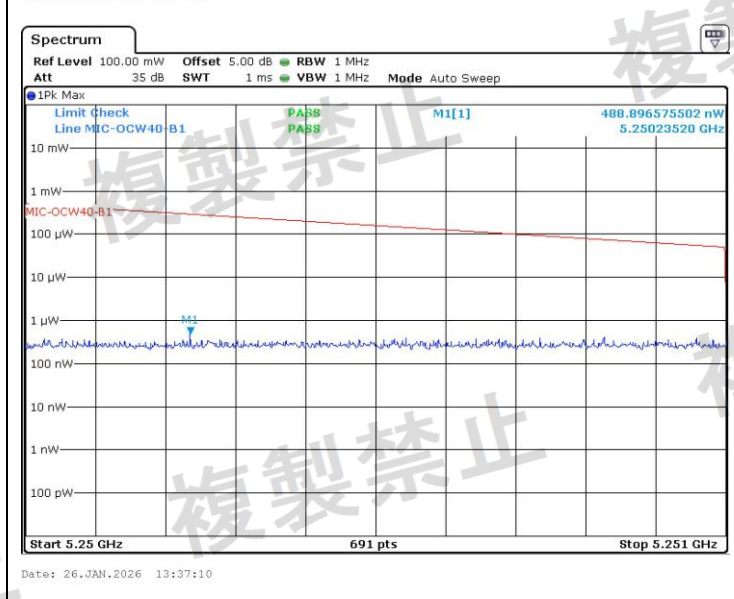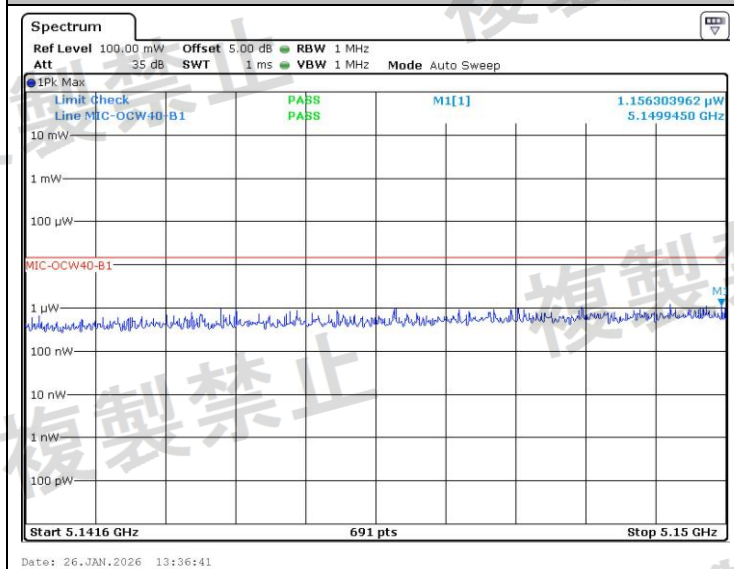

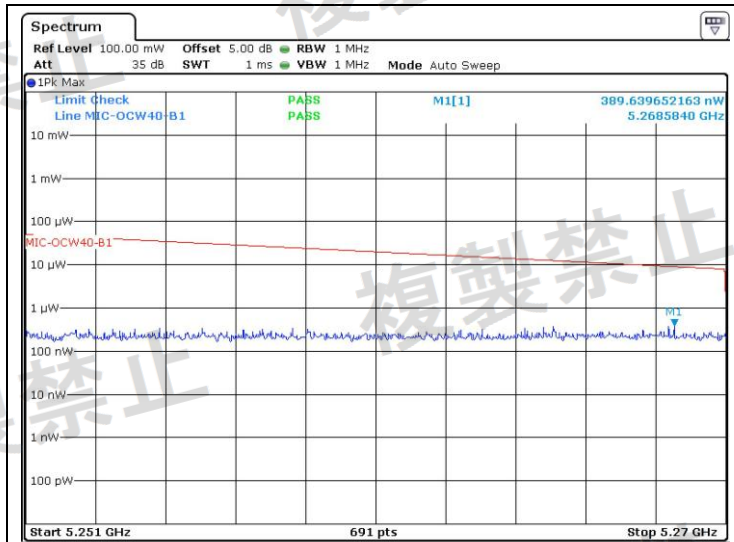


Date: 26.JAN.2026 13:37:28

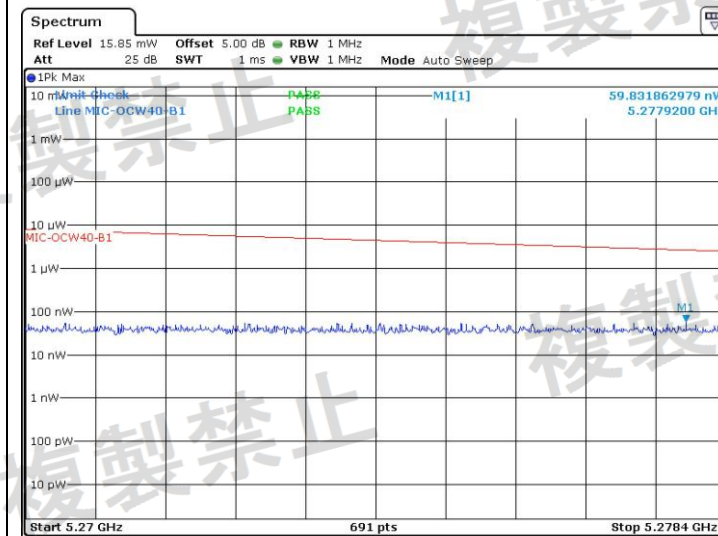



Date: 26.JAN.2026 13:37:52


11AC40SISO_Ant1_5190

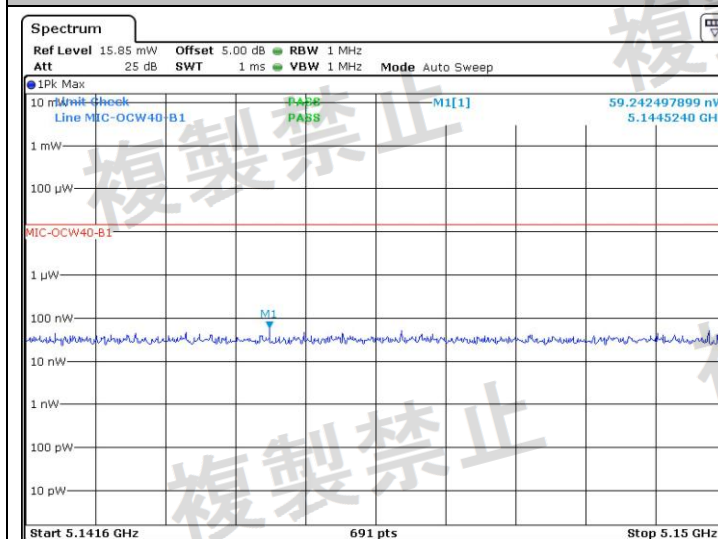



Date: 26.JAN.2026 13:38:20

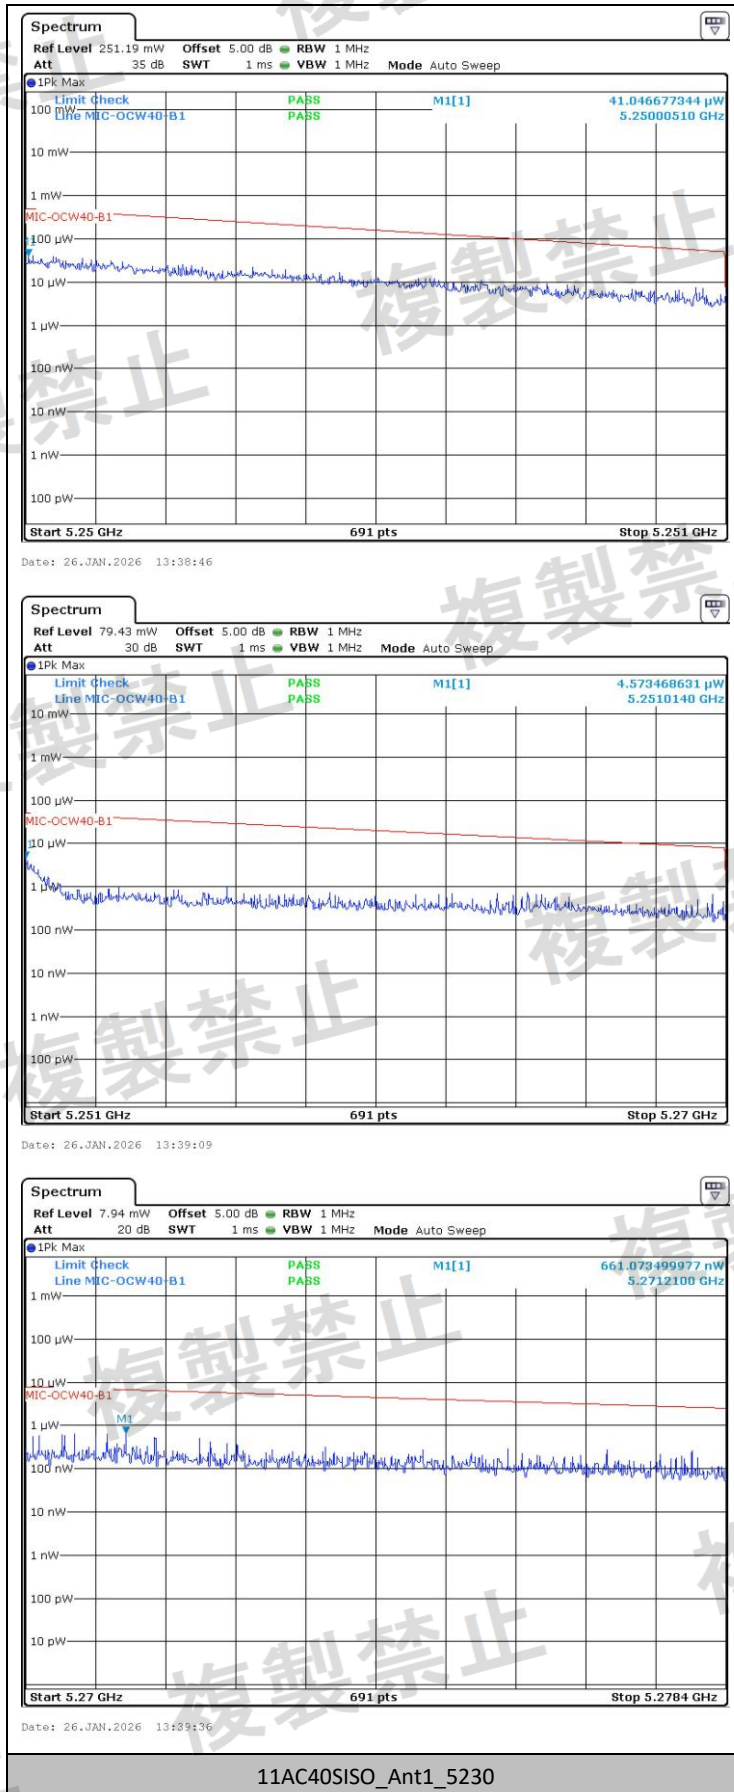


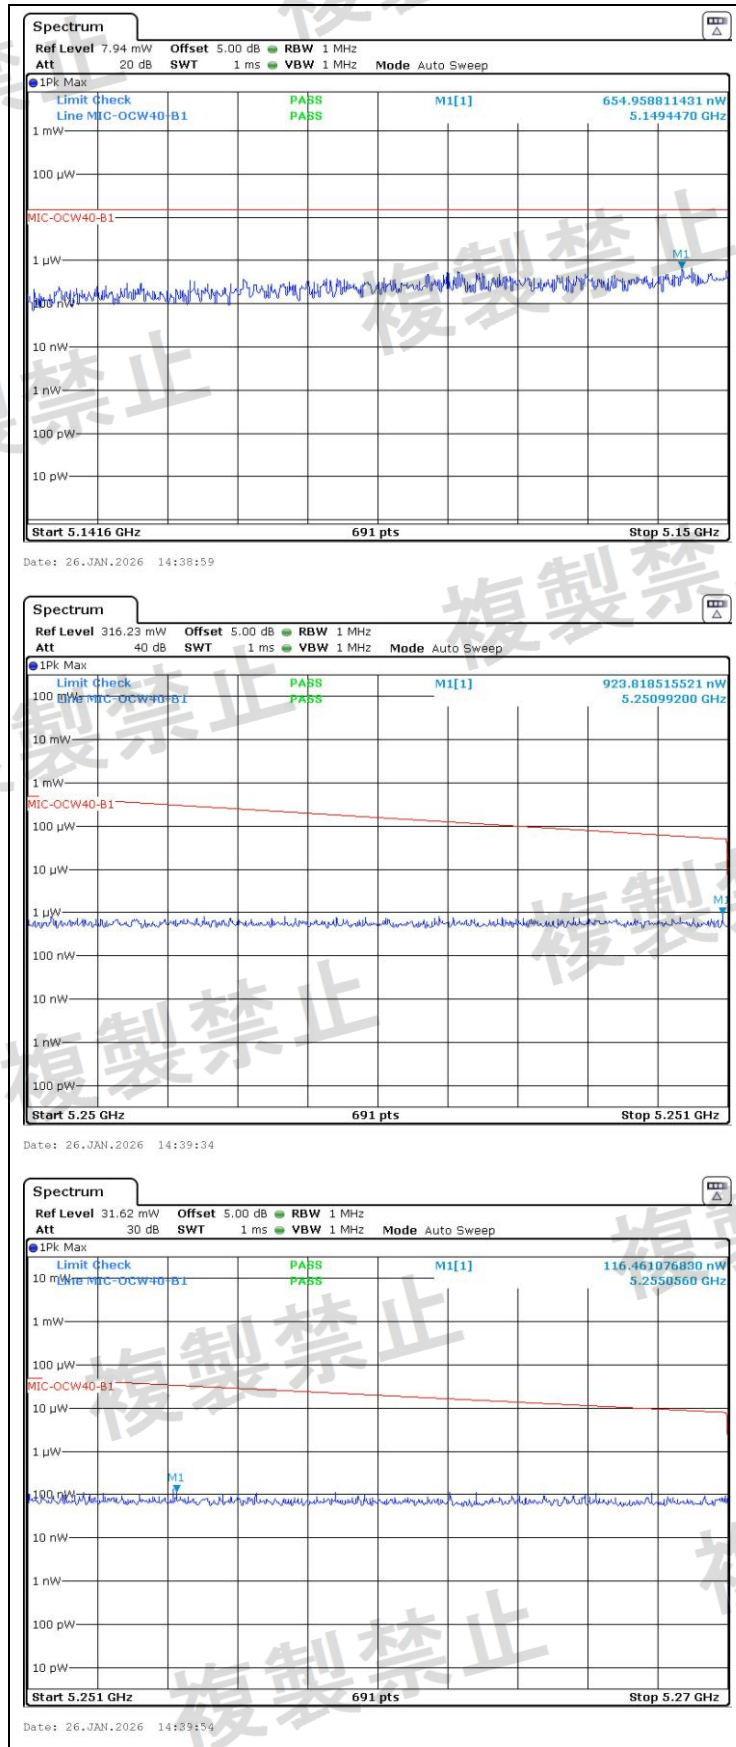

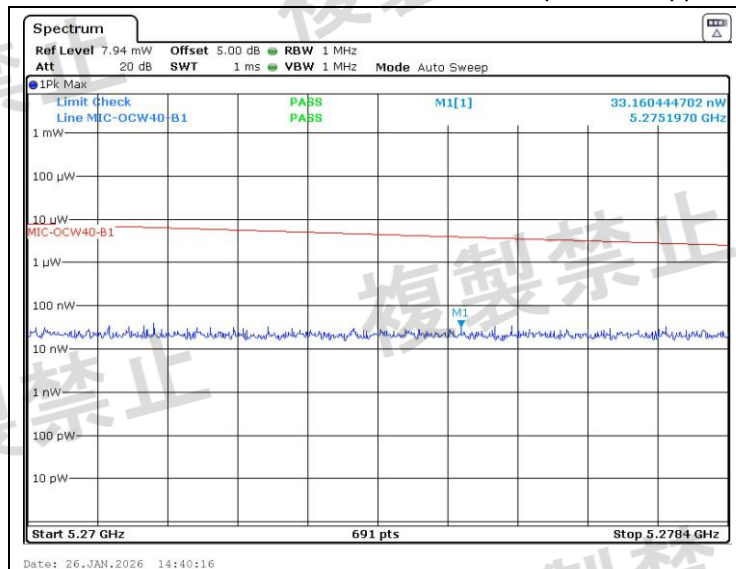


11AC40SISO_Ant2_5190

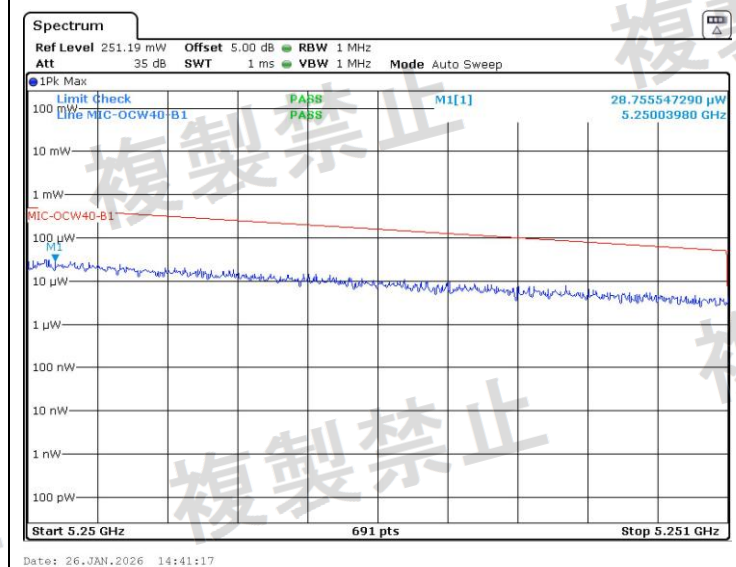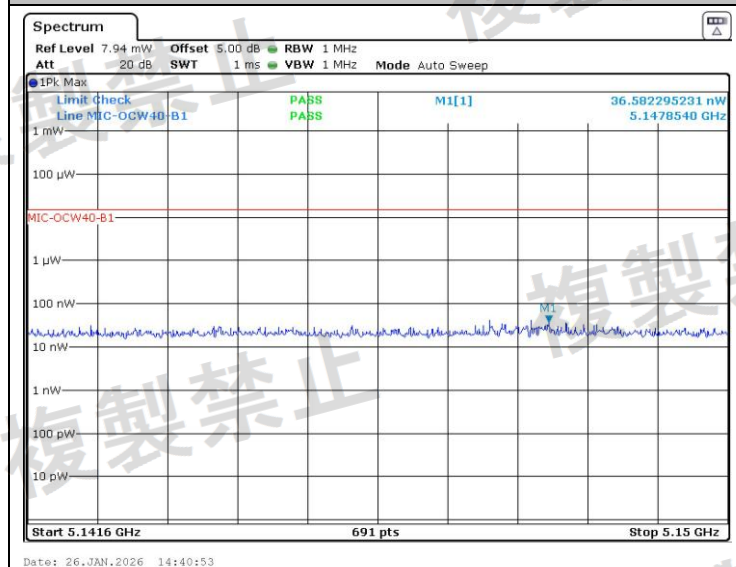

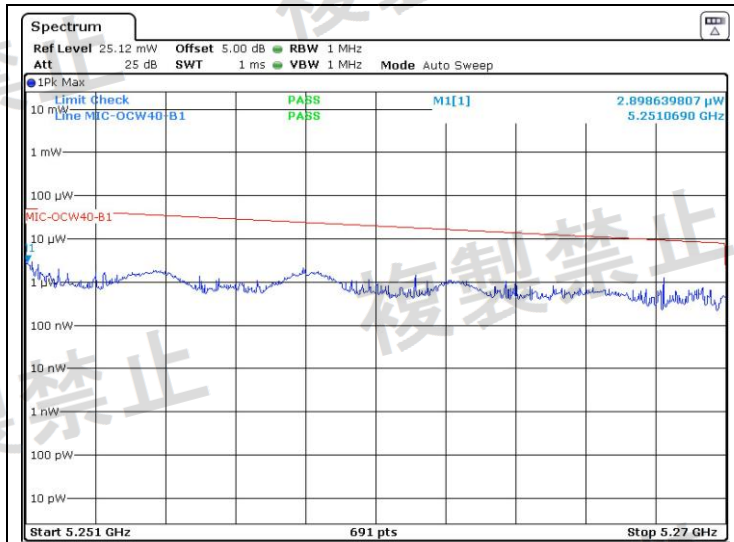


Date: 26.JAN.2026 14:41:41

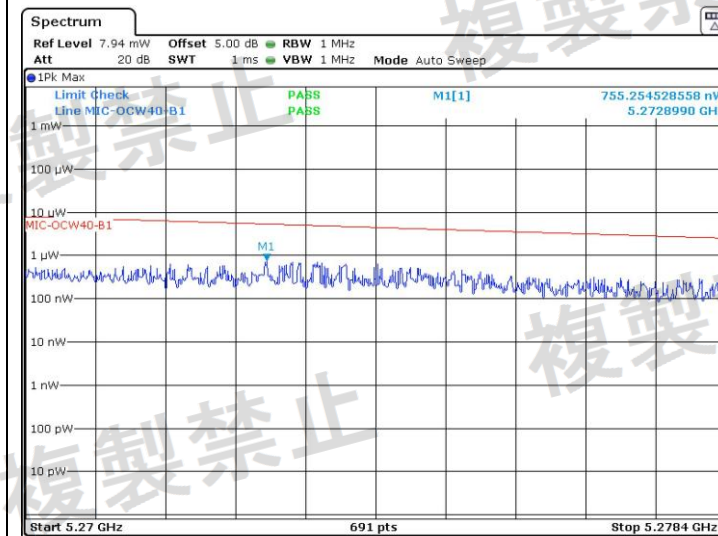



Date: 26.JAN.2026 14:42:02


11AC40SISO_Ant2_5230

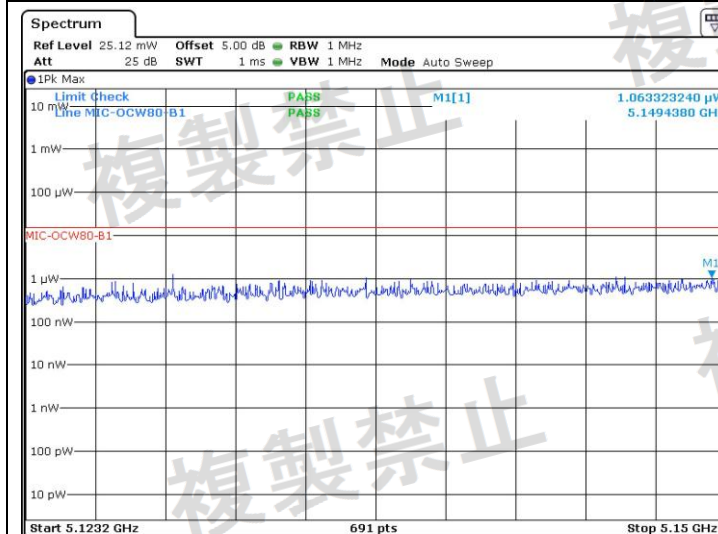



Date: 26.JAN.2026 13:44:34

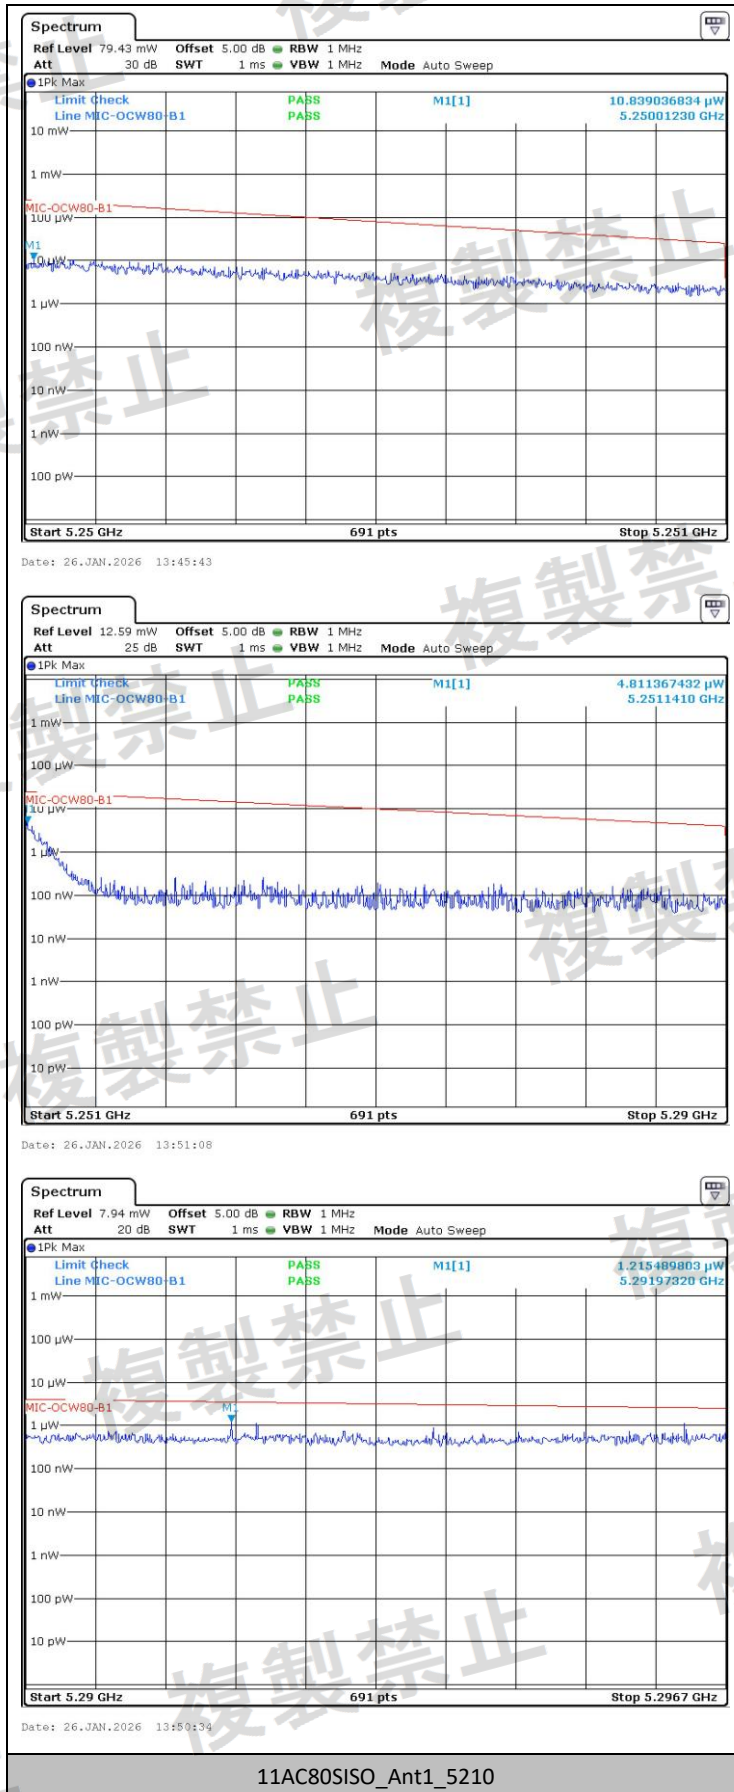


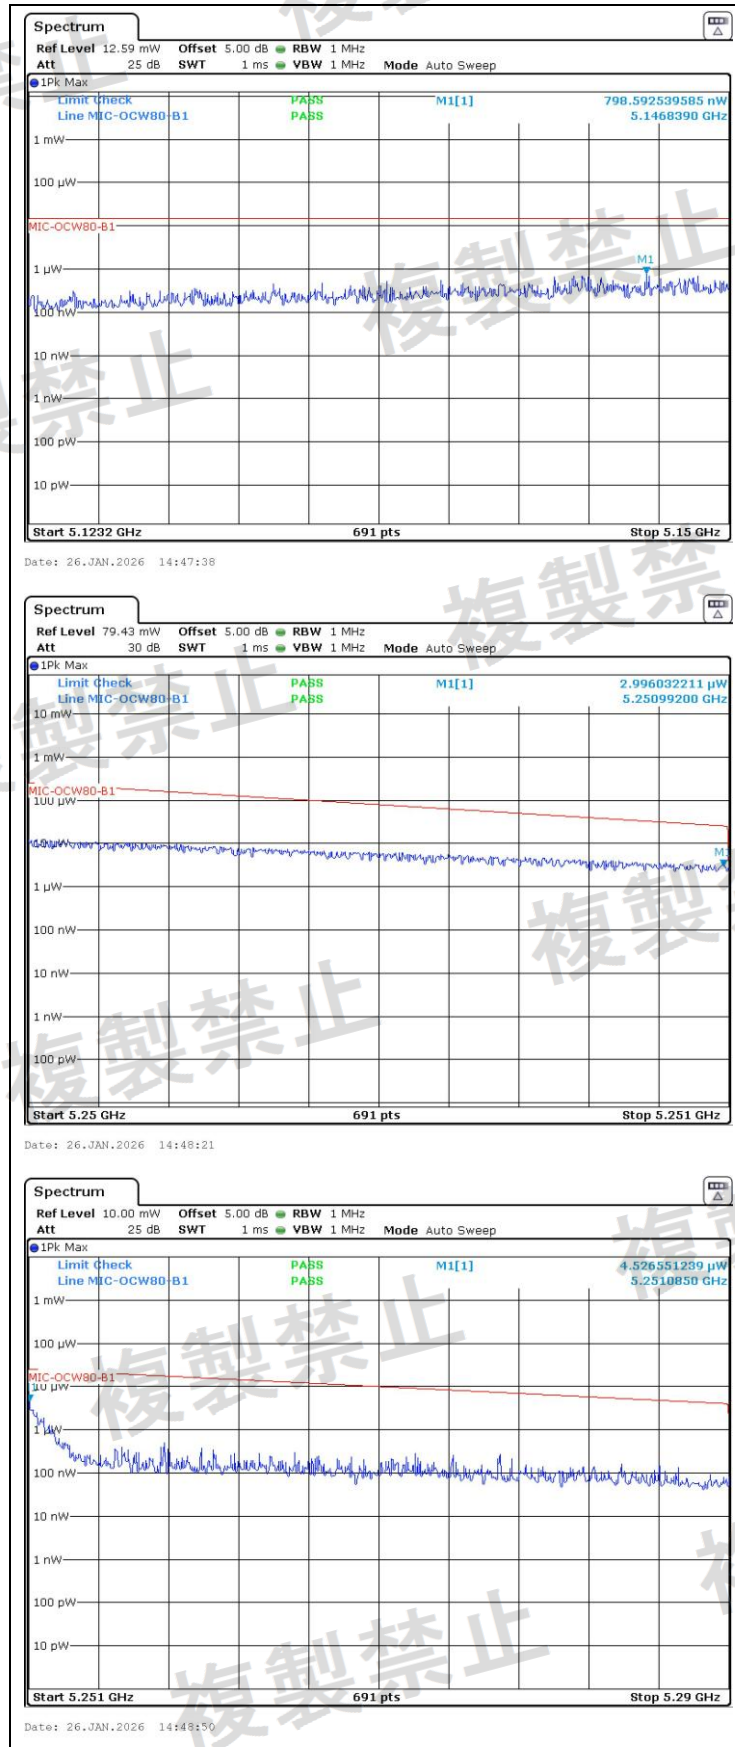


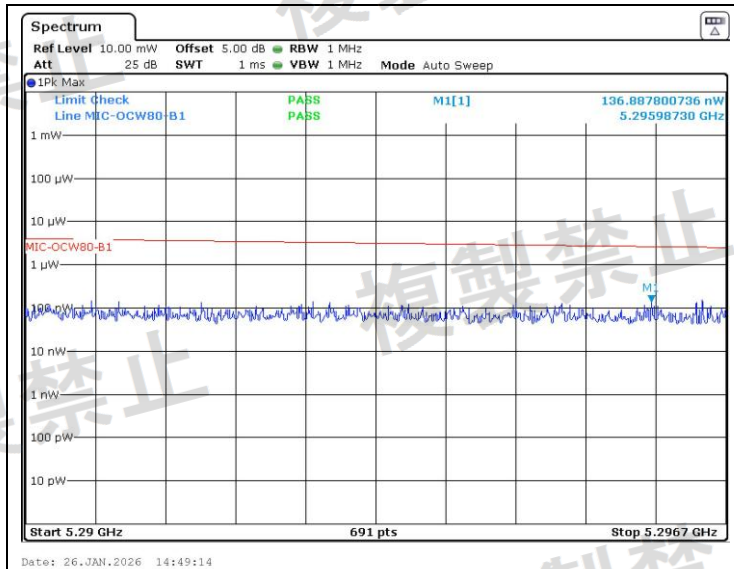



11AC80SISO_Ant2_5210

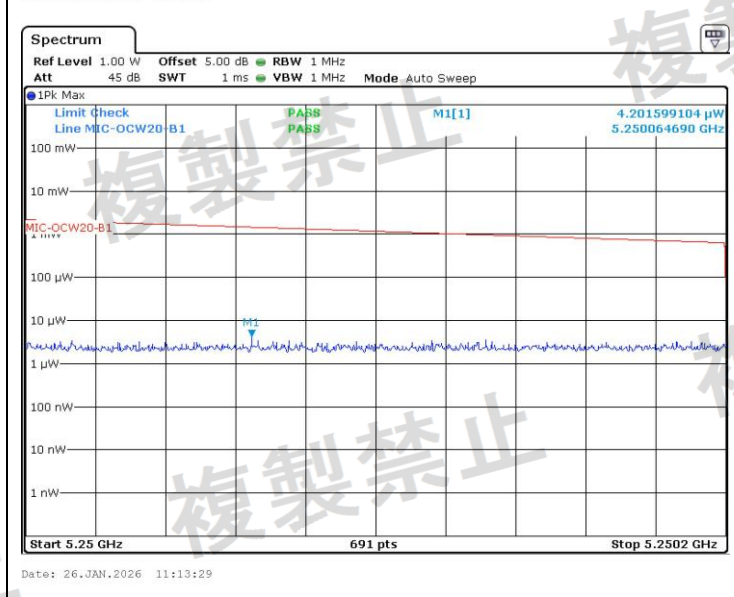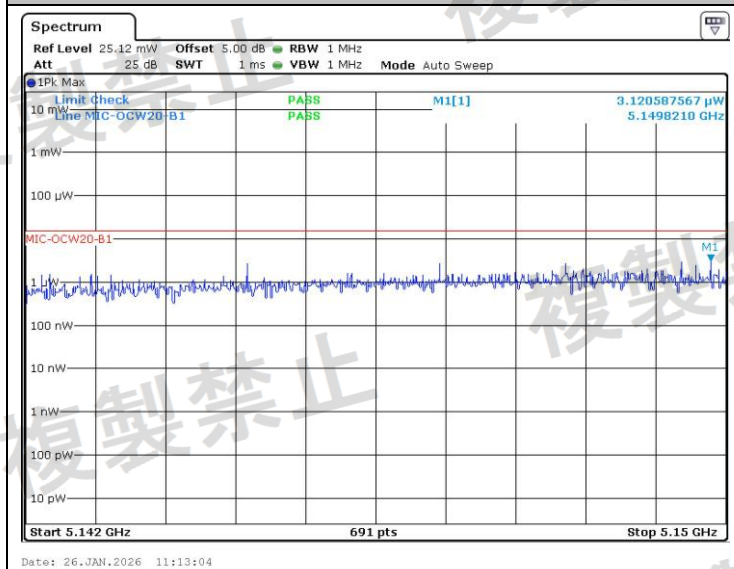


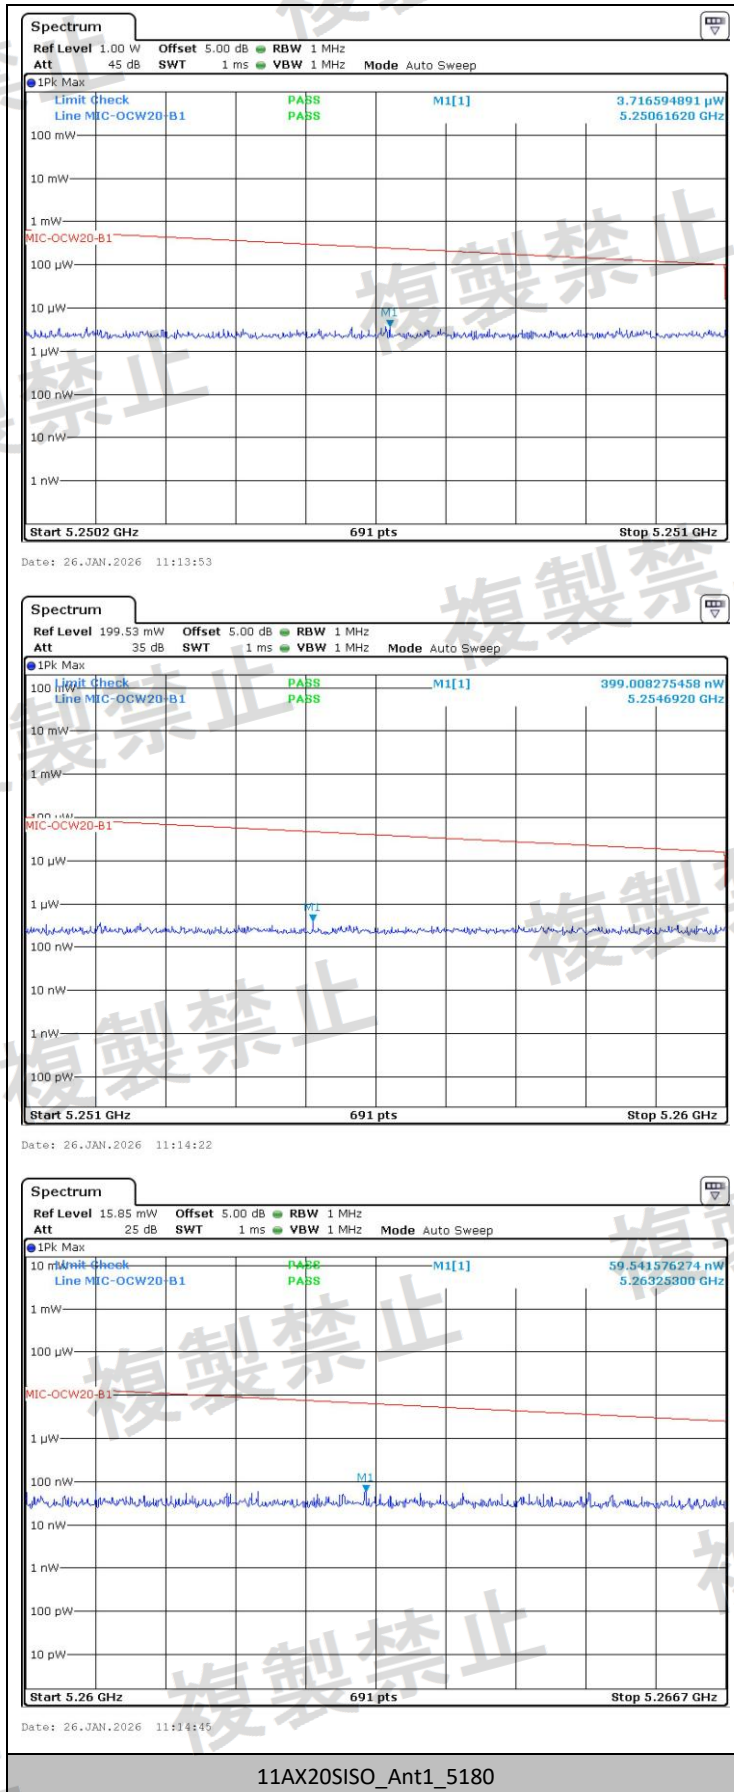


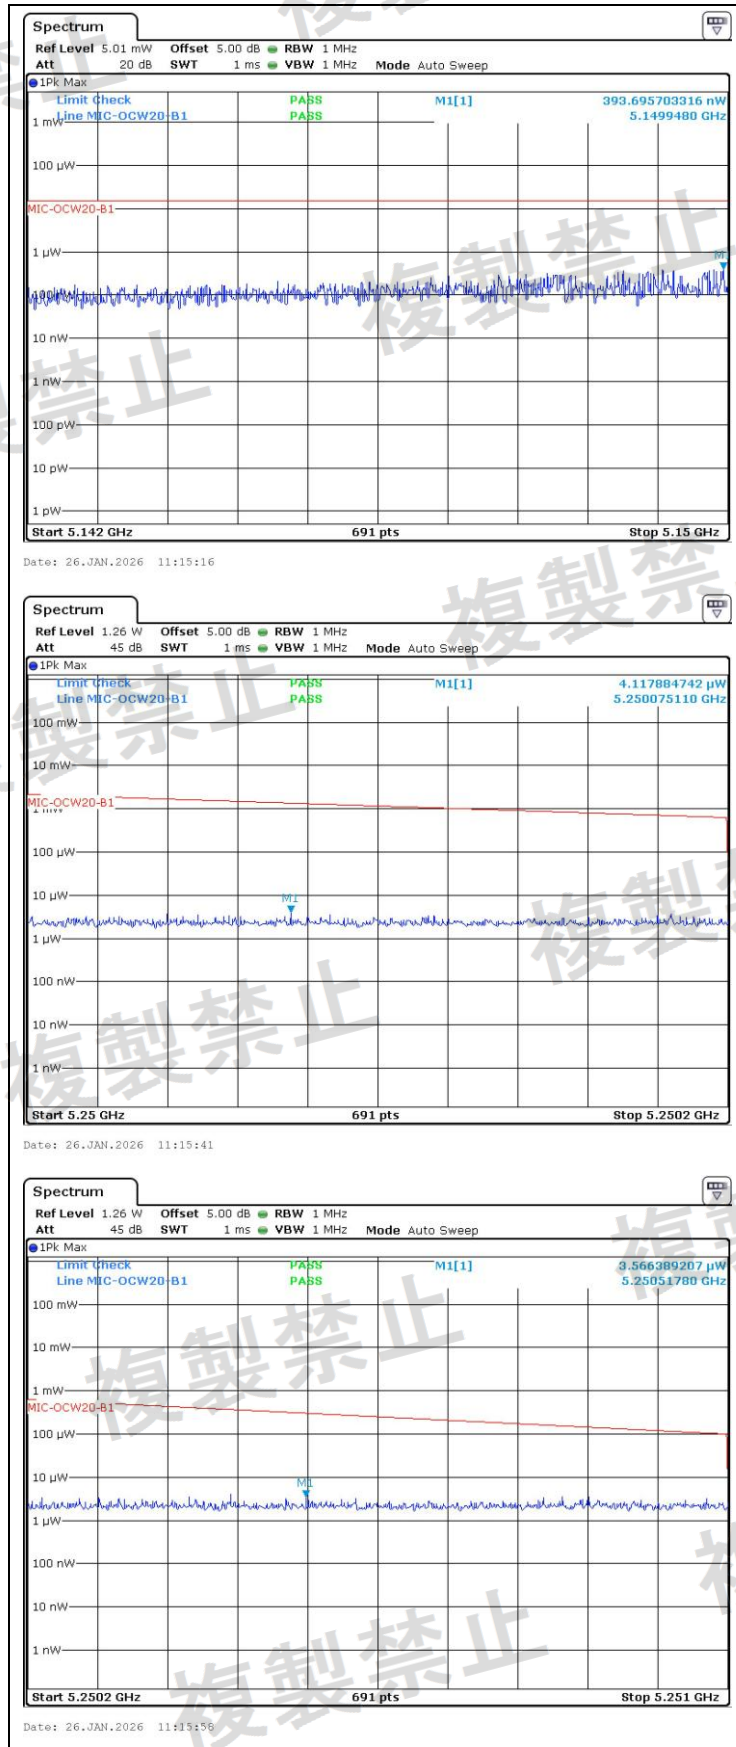


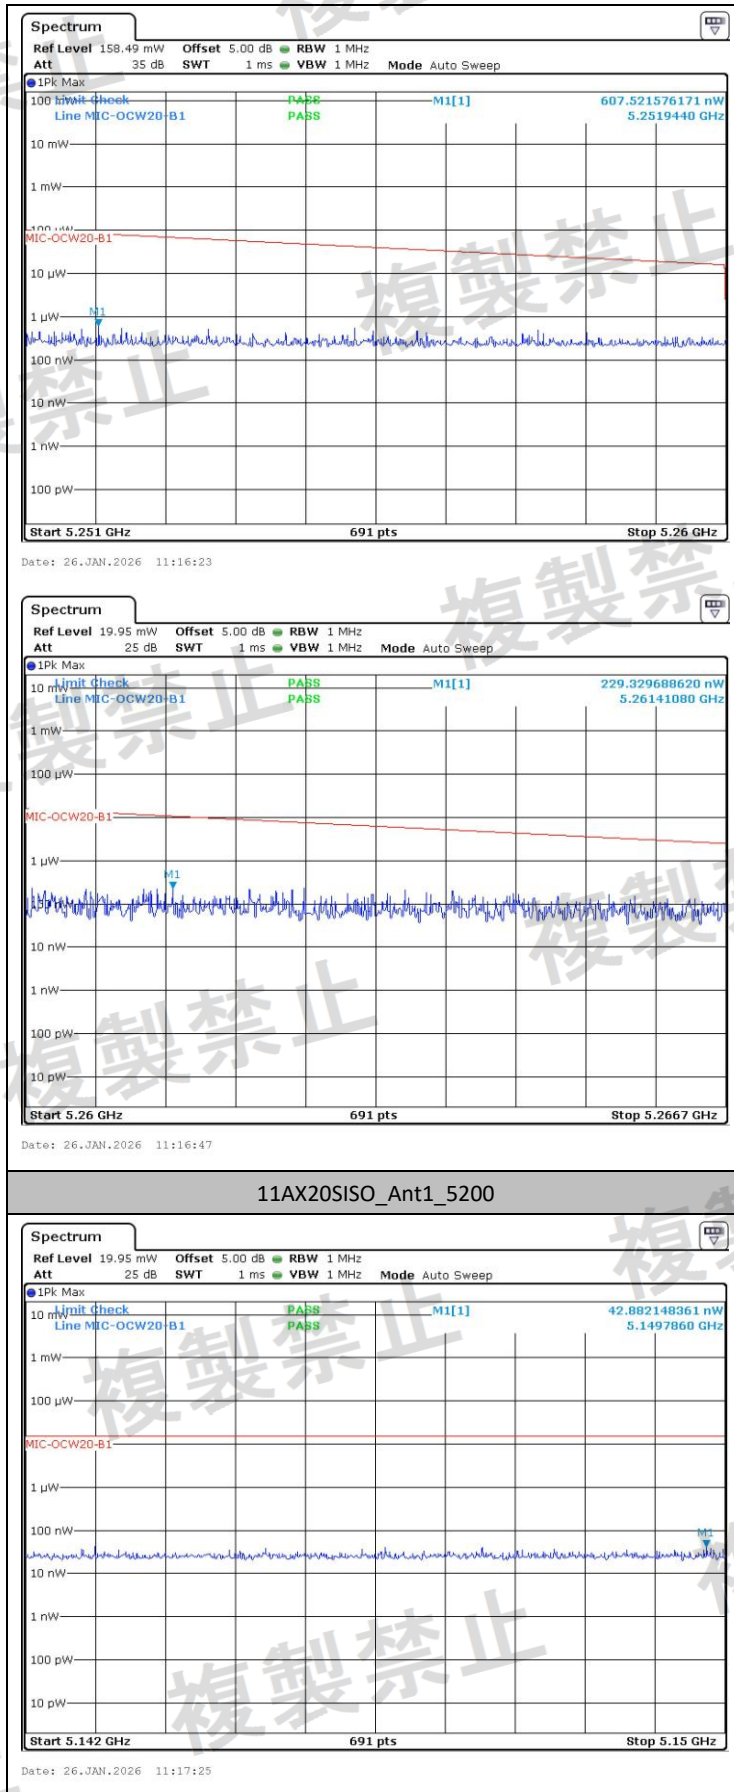


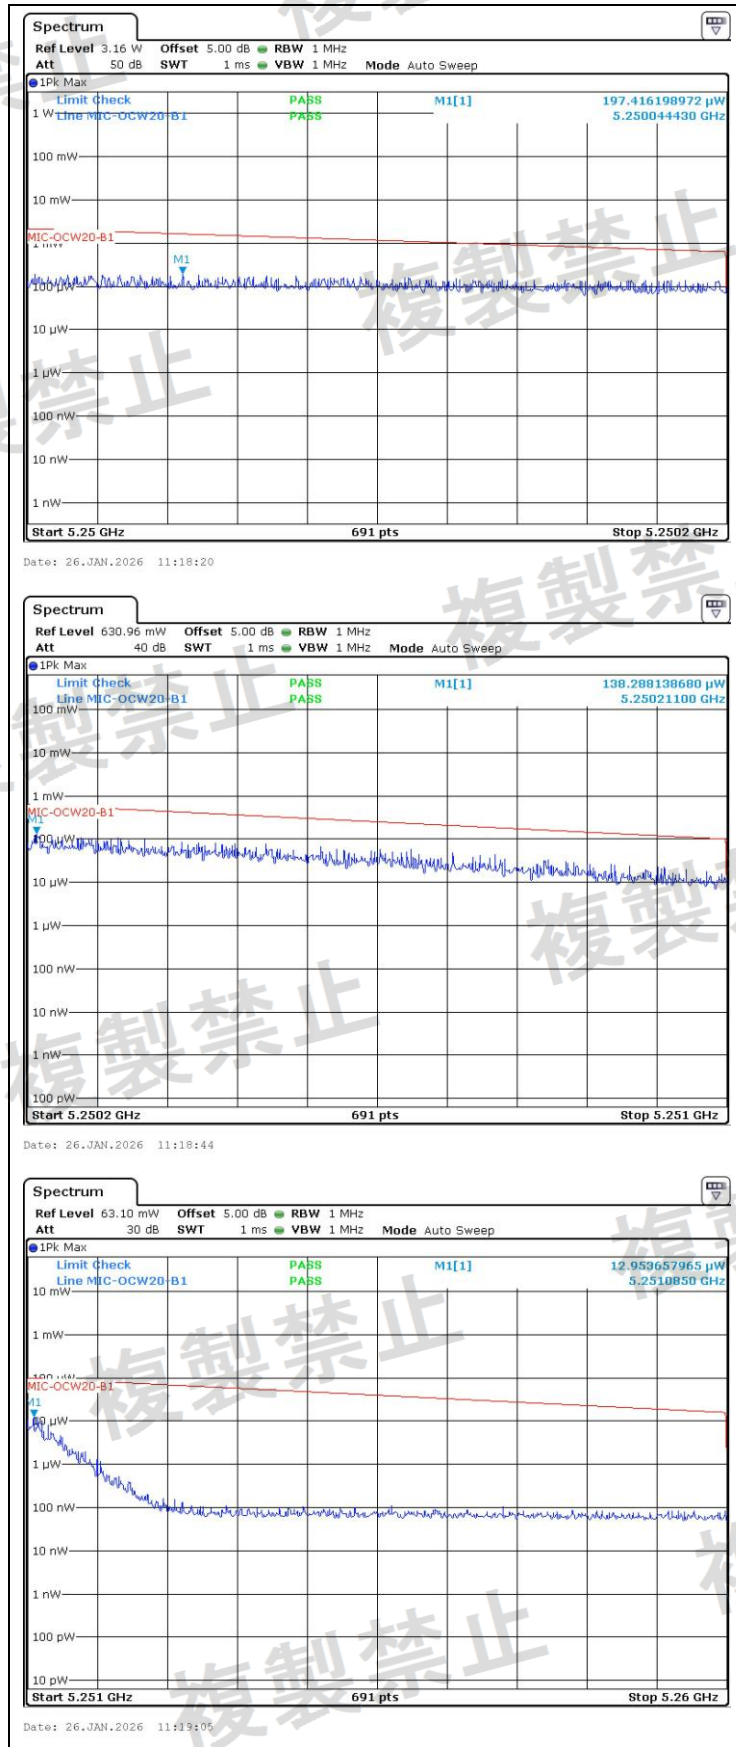



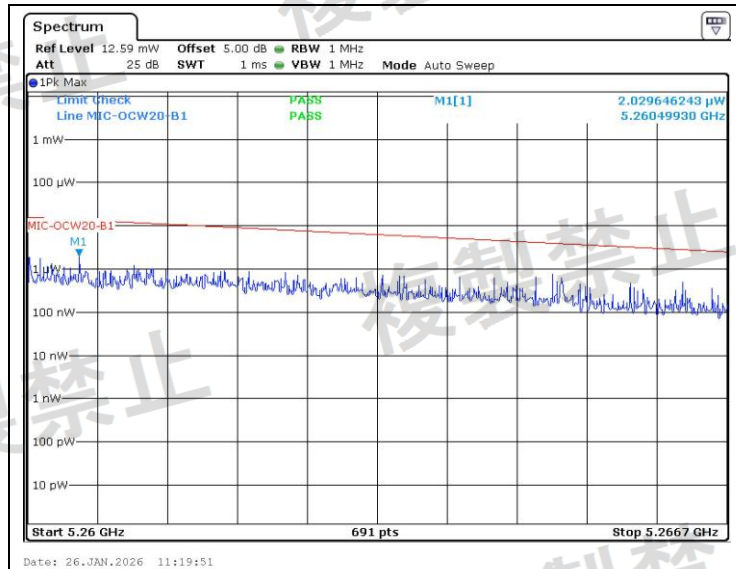


11AX20SISO_Ant1_5240

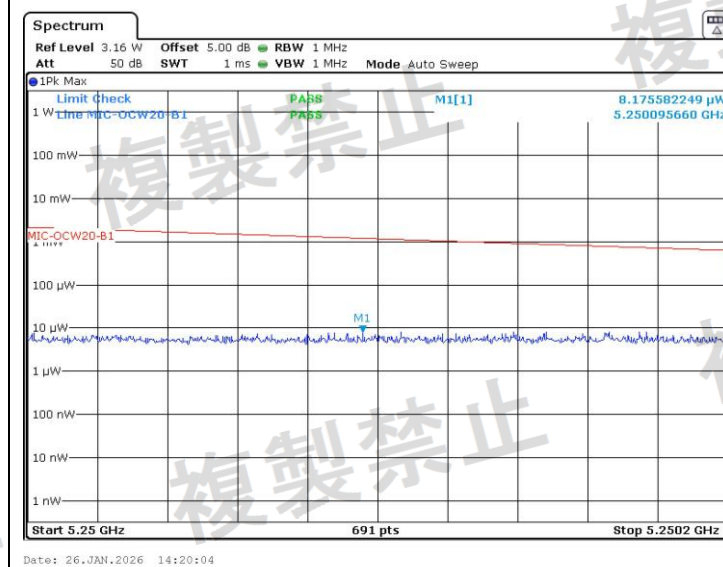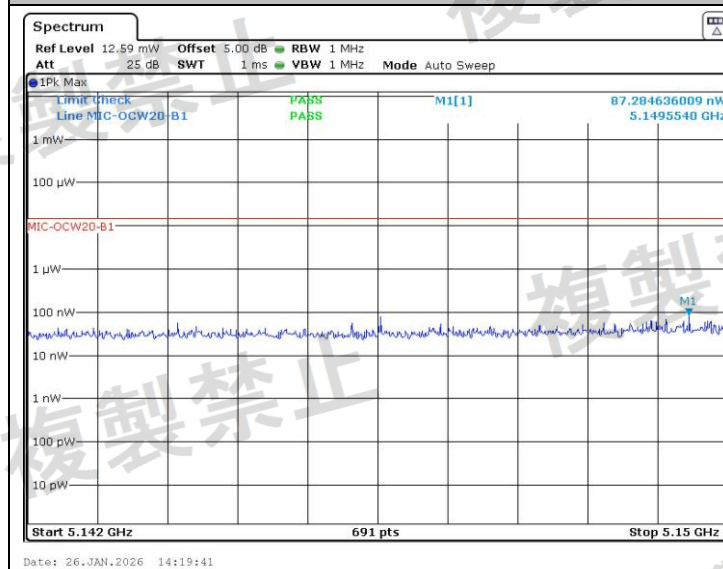


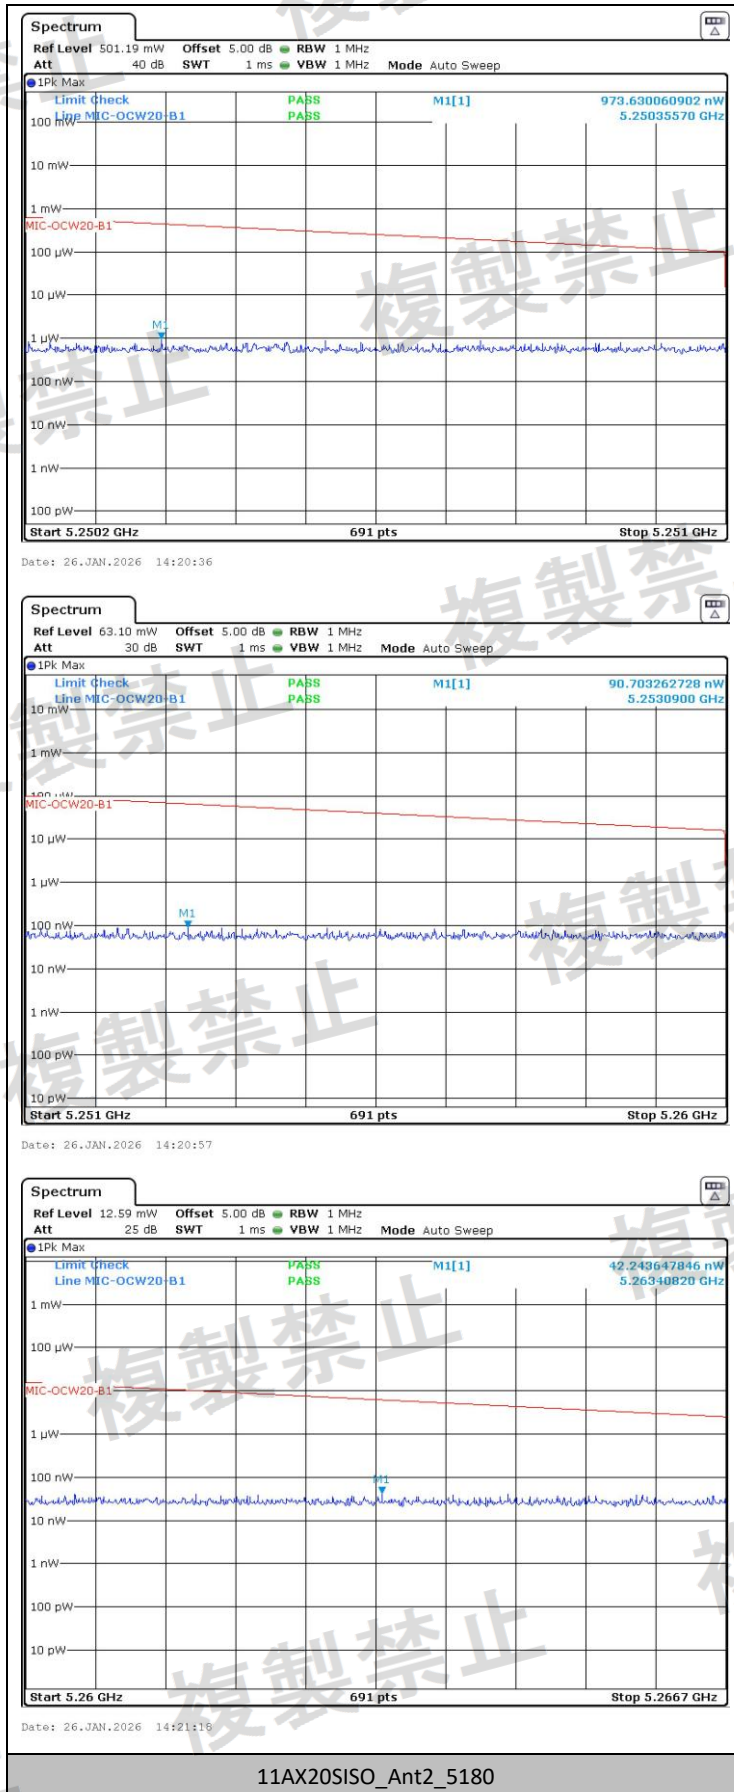


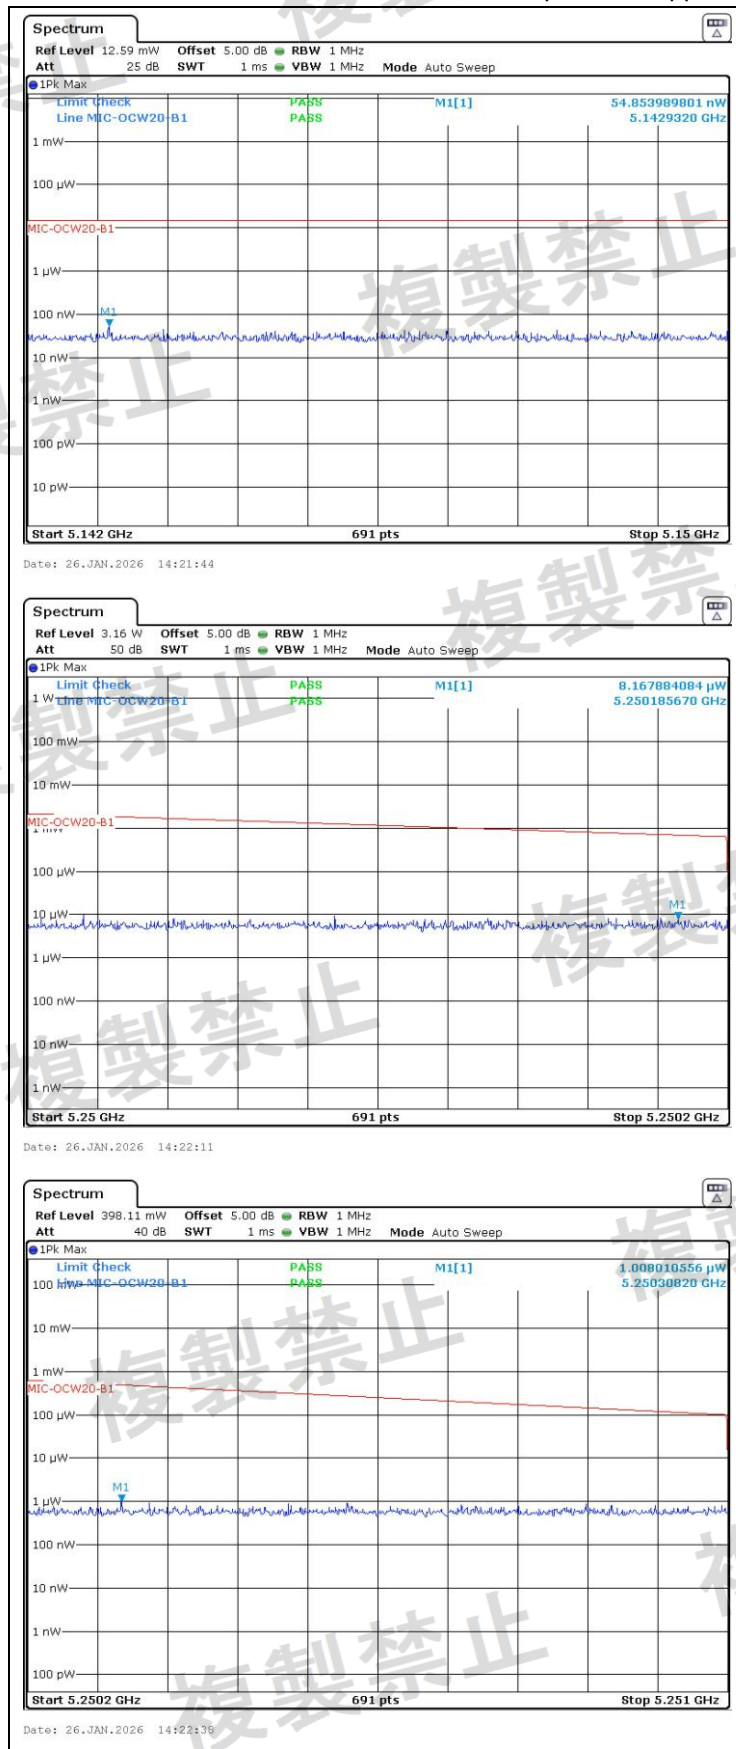


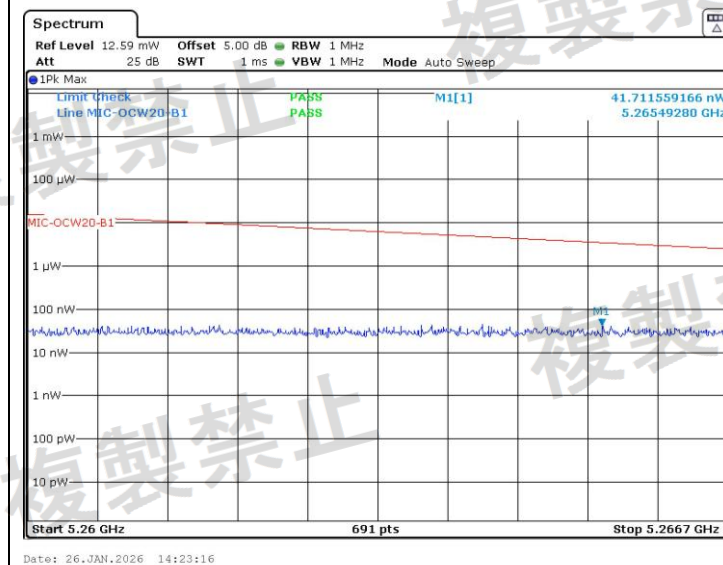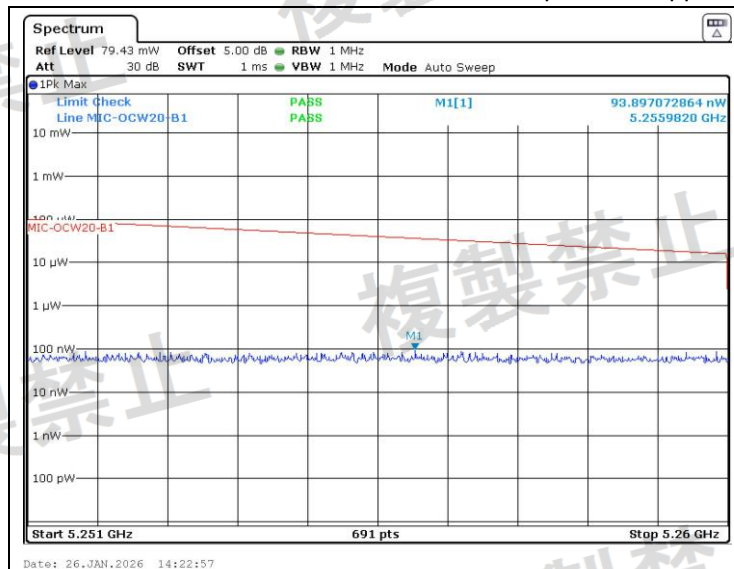



11AX20SISO_Ant2_5200

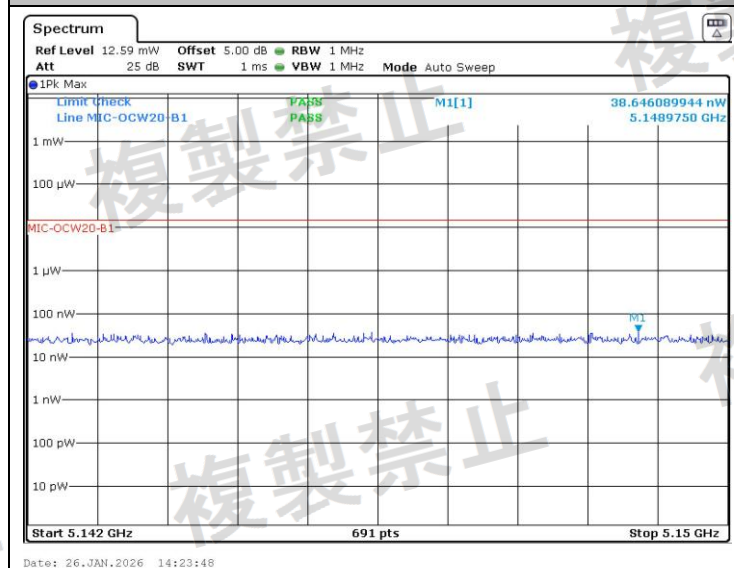


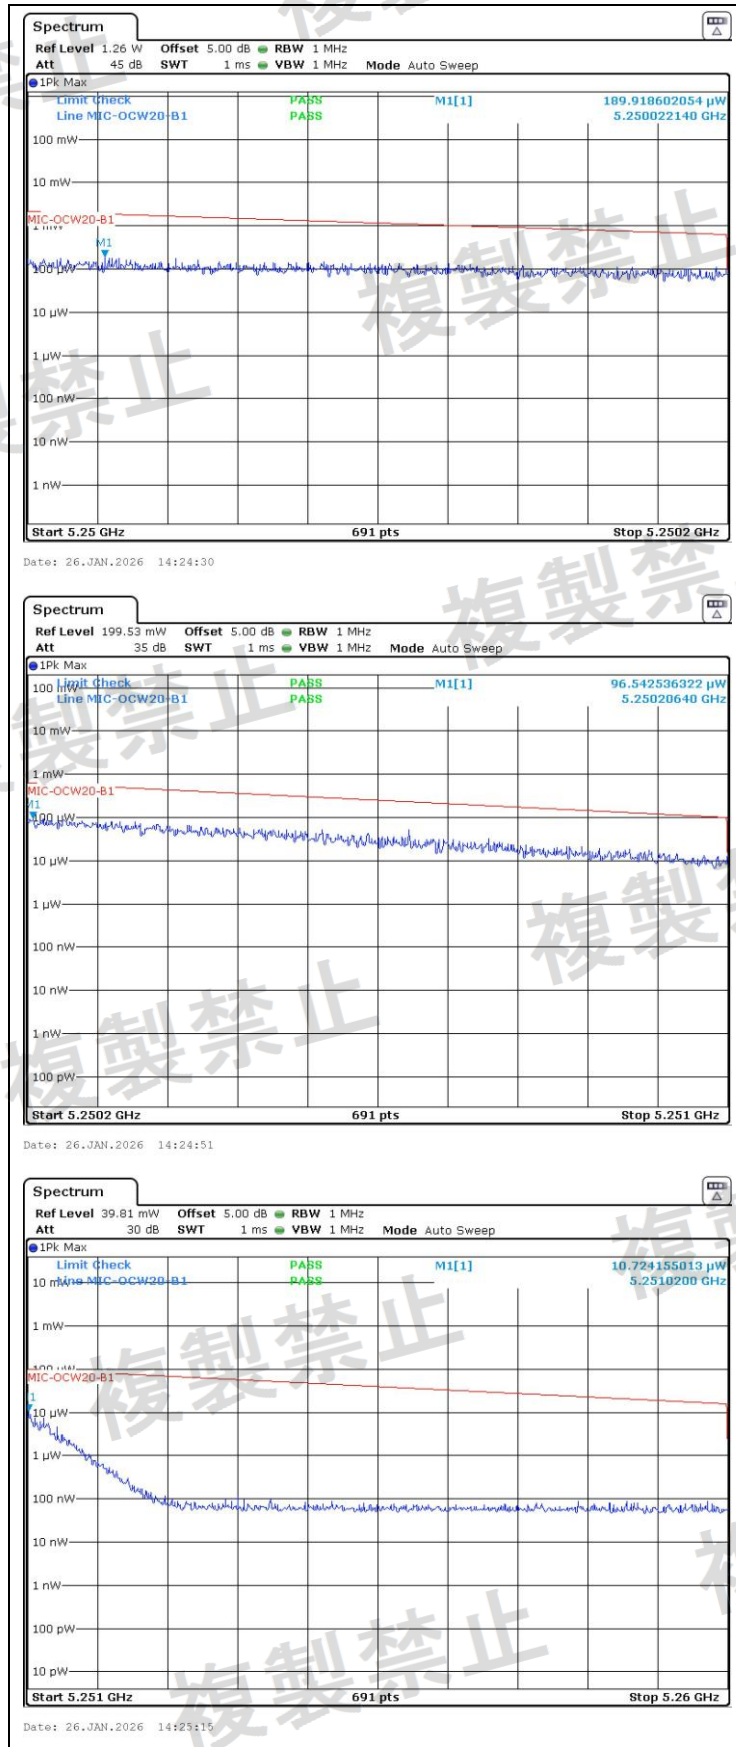

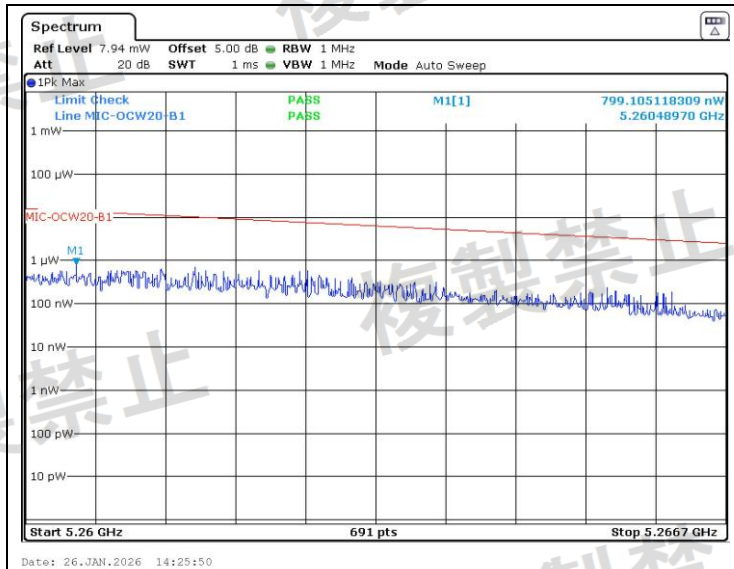


11AX20SISO_Ant2_5240

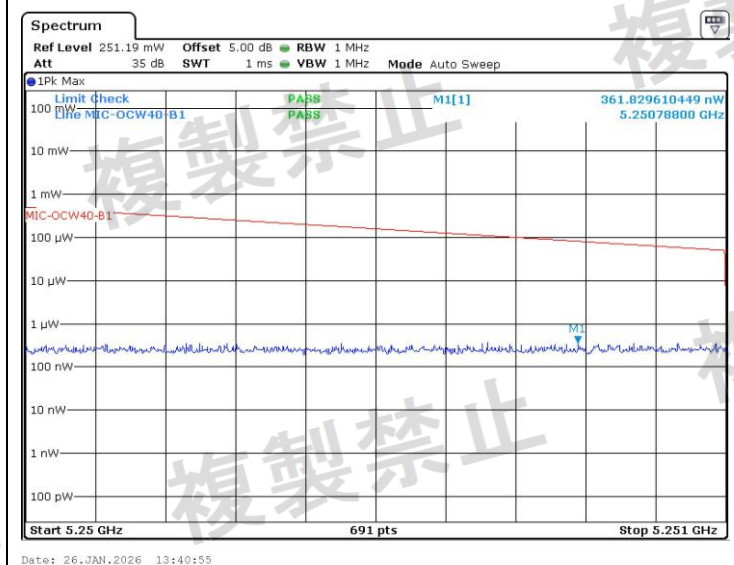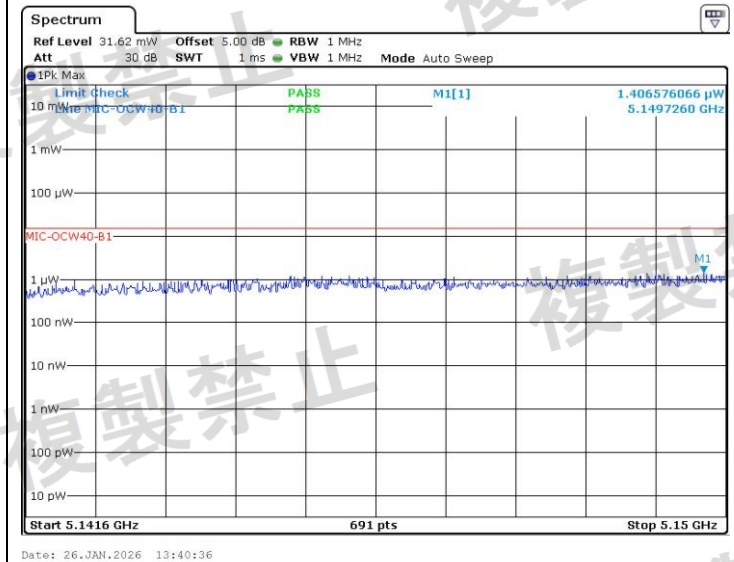

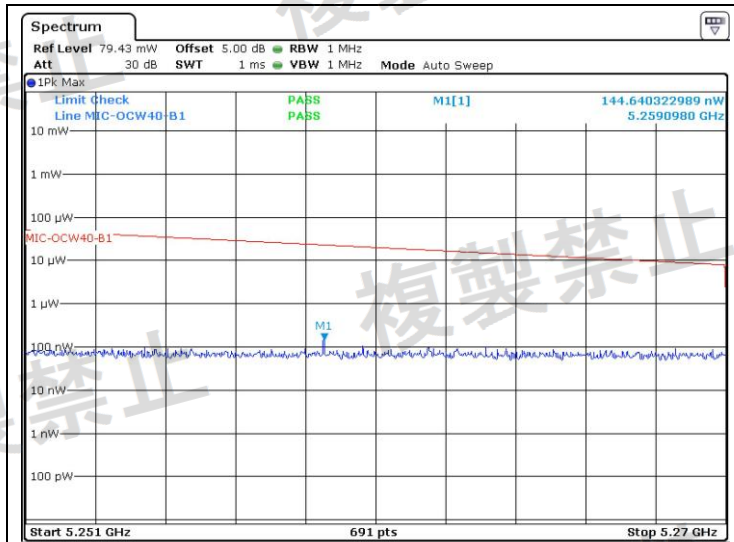


Date: 26.JAN.2026 13:41:14

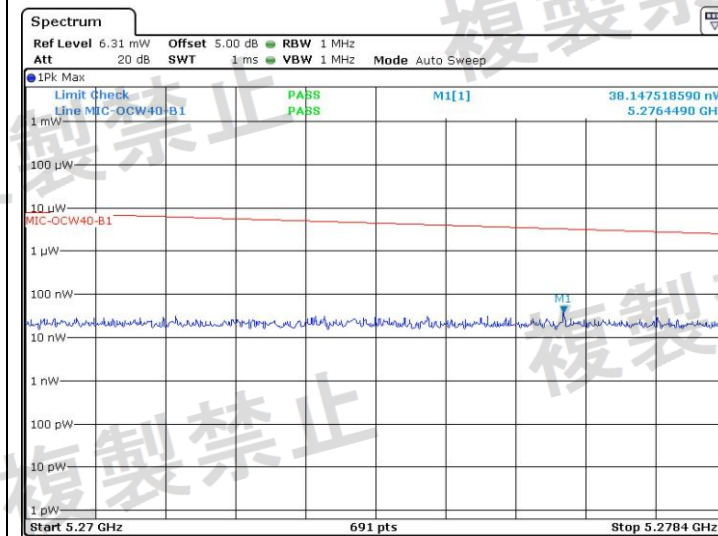



Date: 26.JAN.2026 13:41:32


11AX40SISO_Ant1_5190

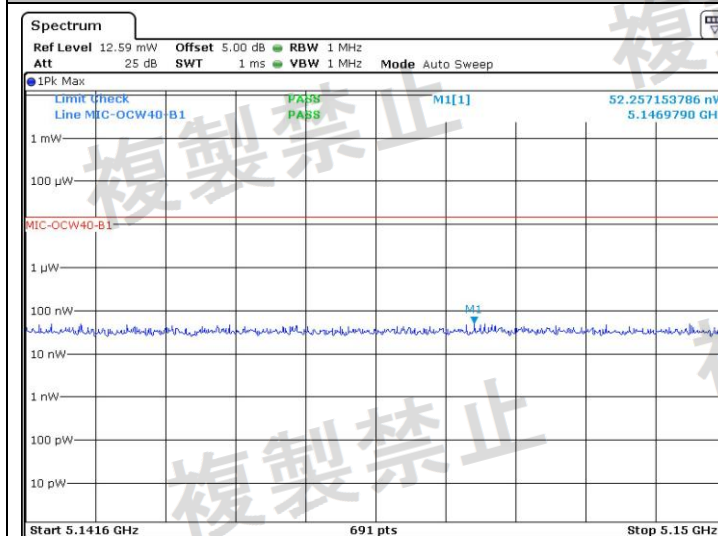



Date: 26.JAN.2026 13:42:05

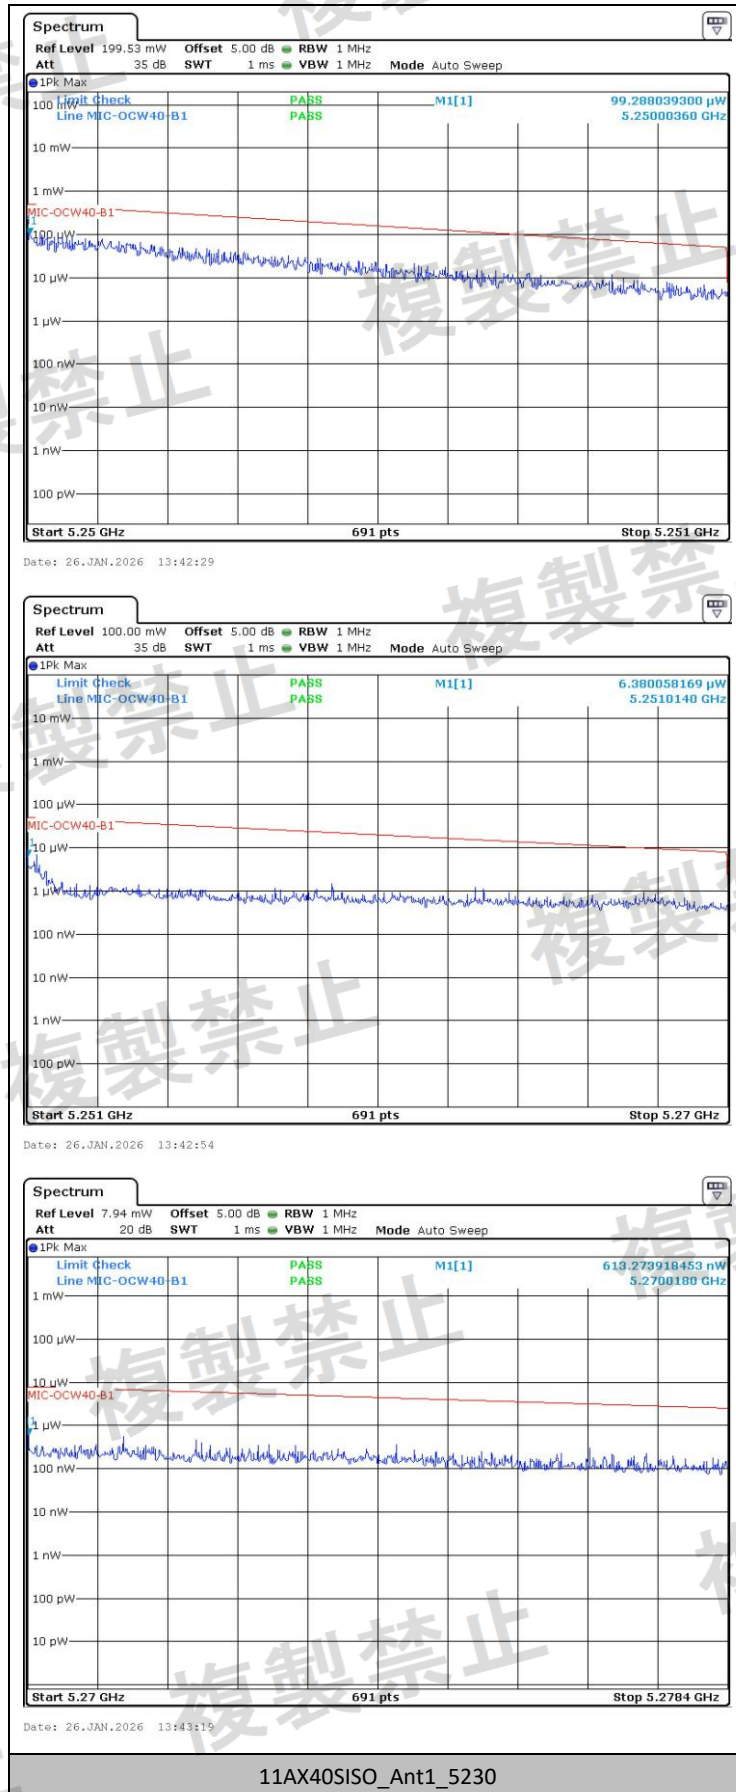


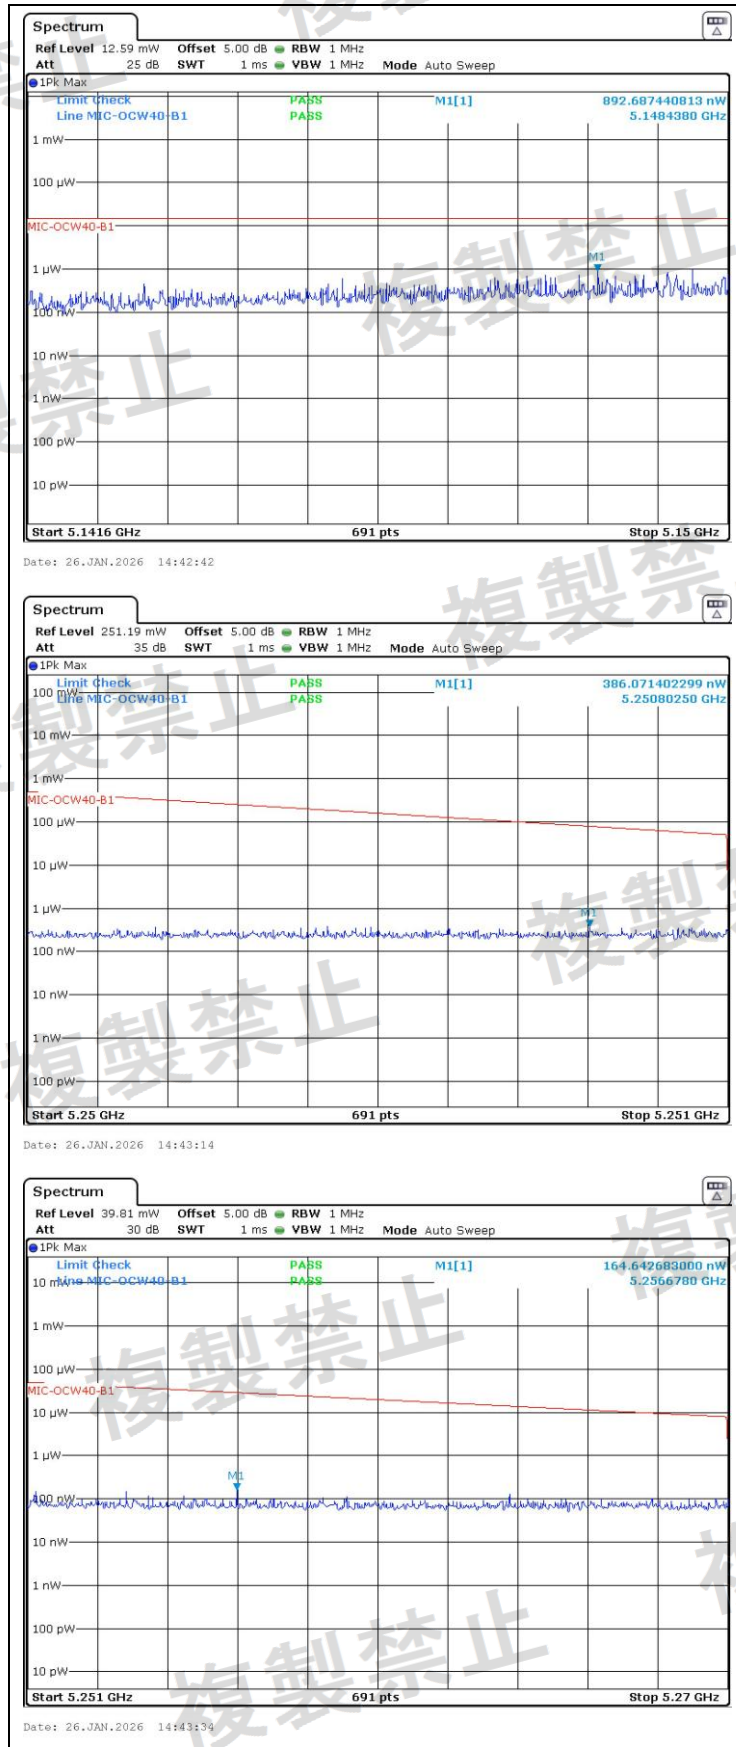

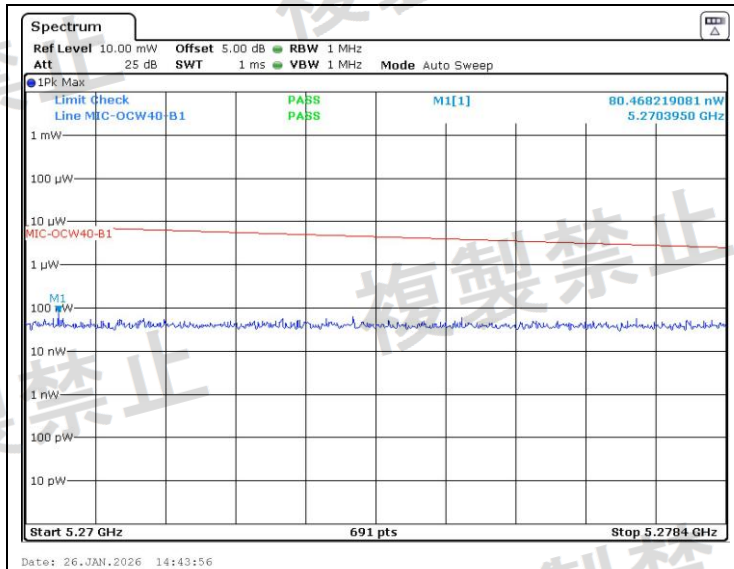


11AX40SISO_Ant2_5190

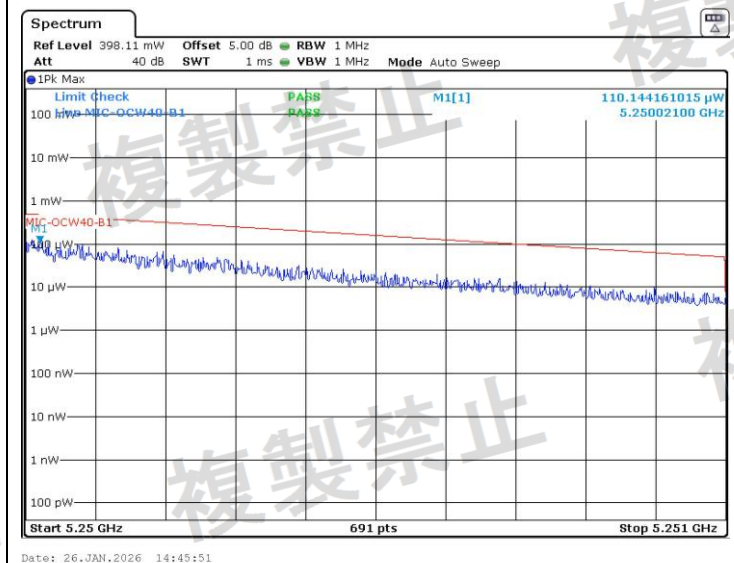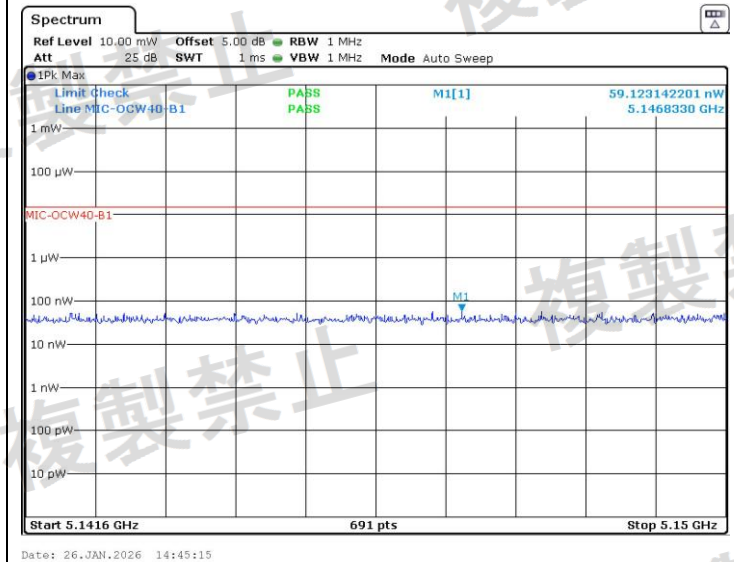

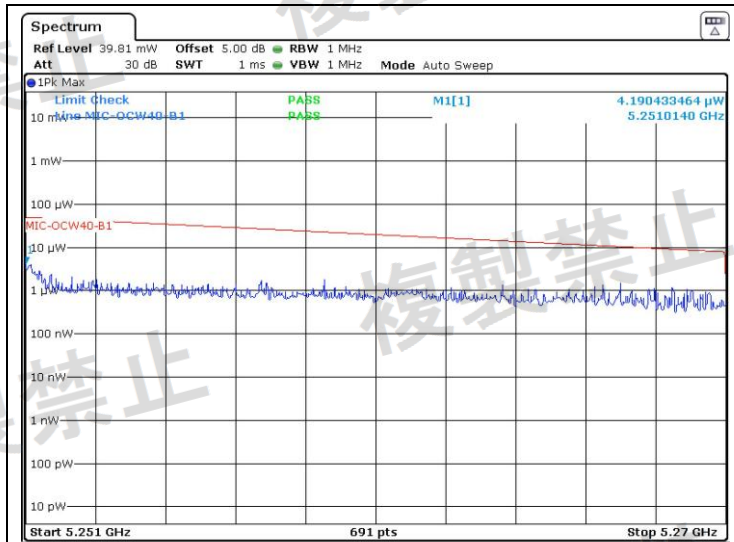


Date: 26.JAN.2026 14:46:11

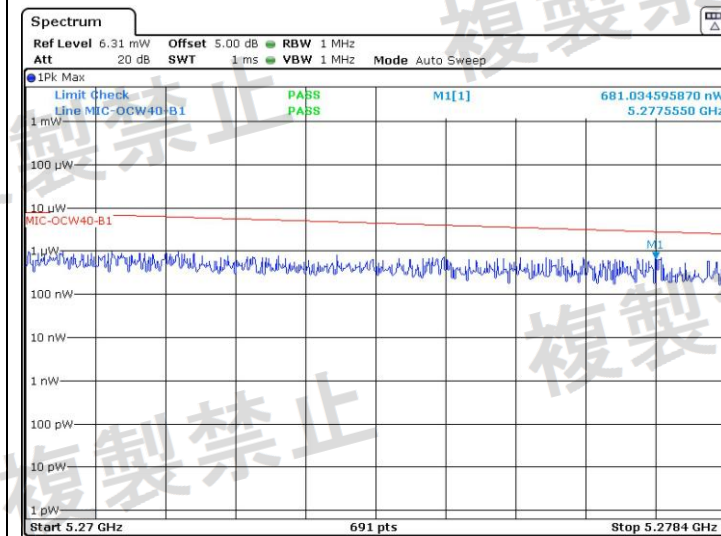



Date: 26.JAN.2026 14:46:41


11AX40SISO_Ant2_5230

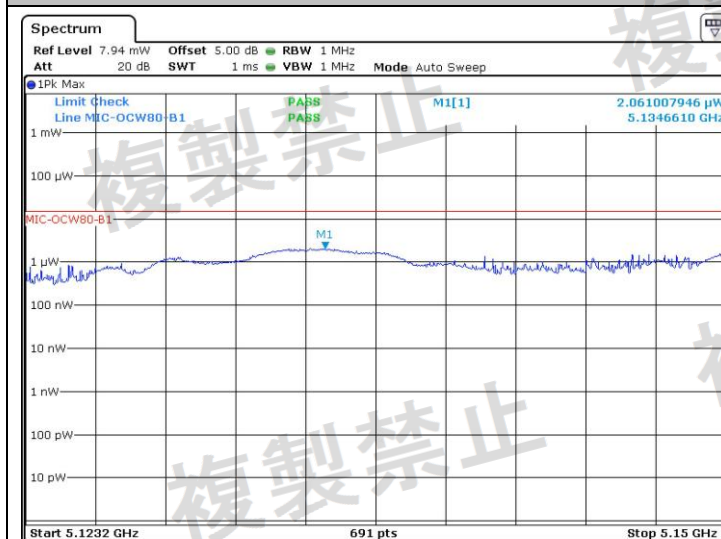

Date: 26.JAN.2026 13:47:24

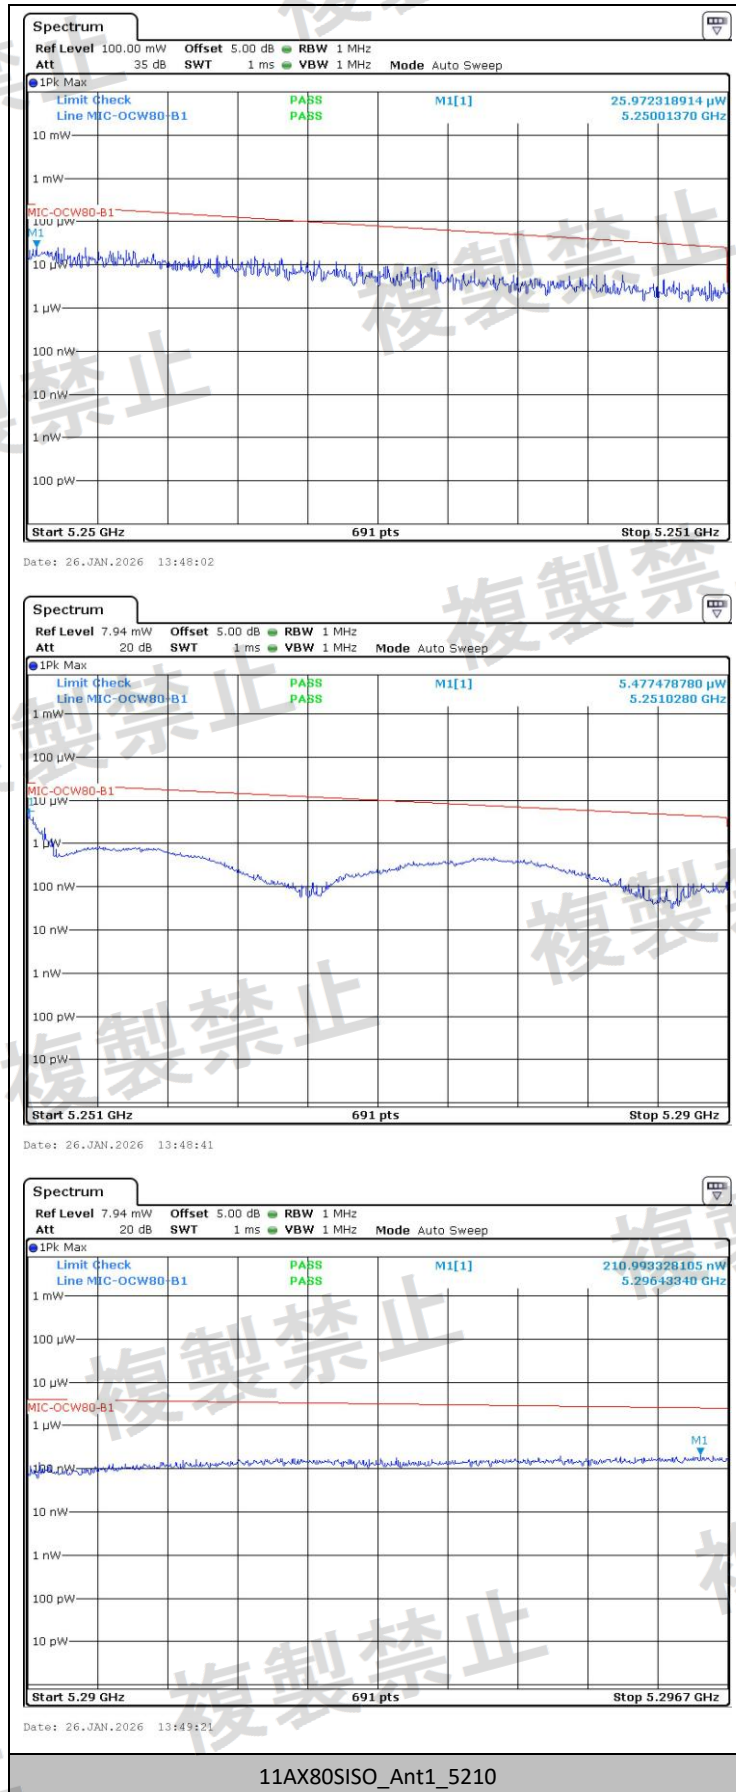


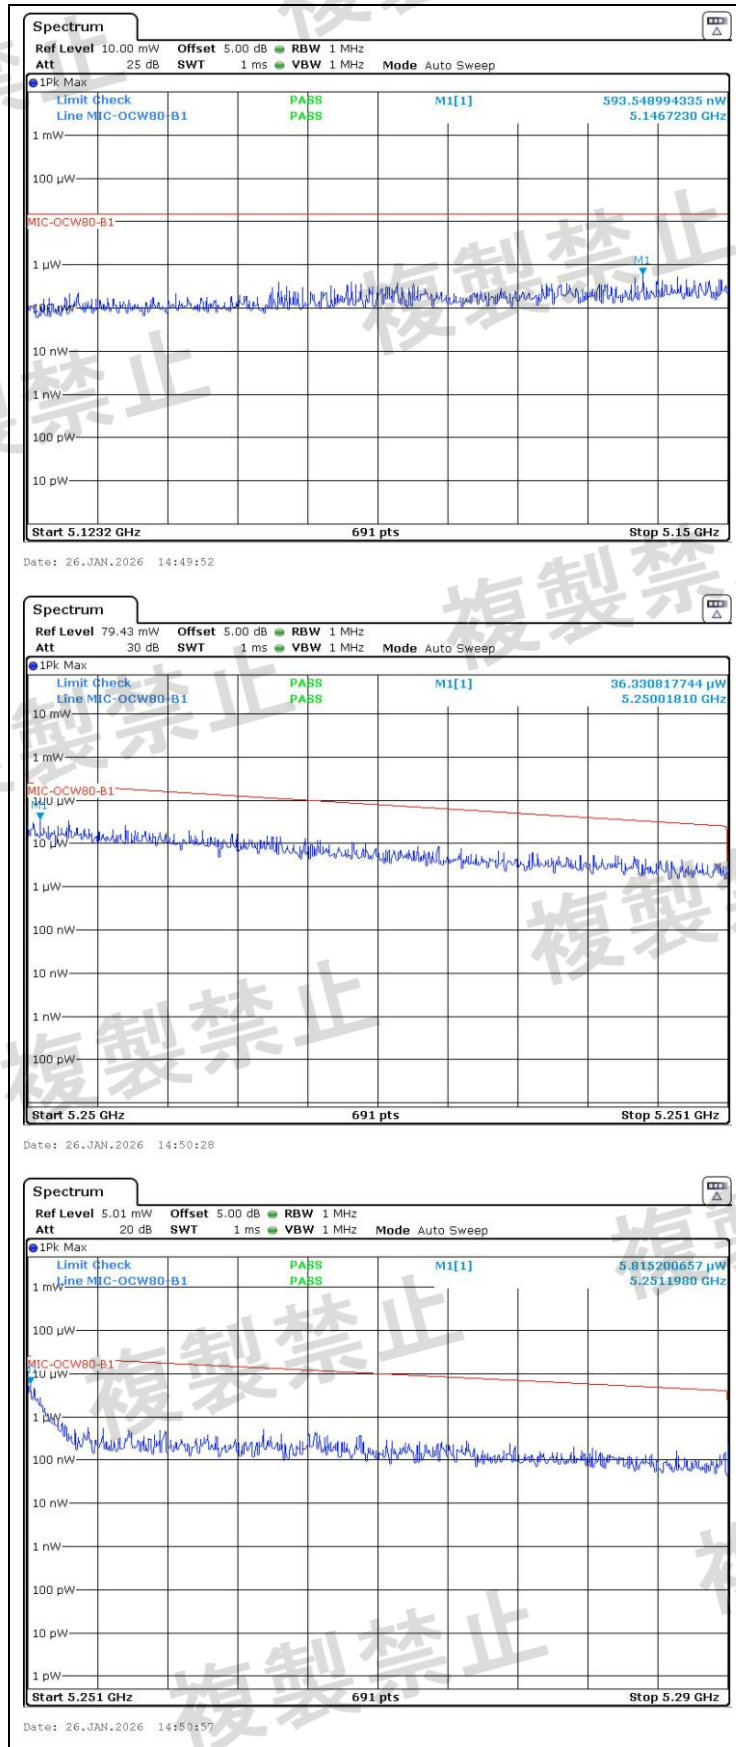


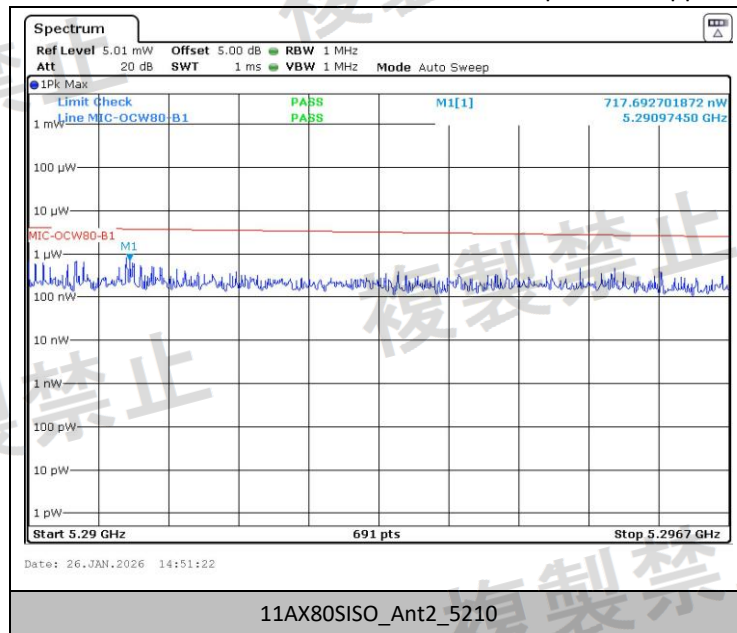


Appendix E: Antenna Power & EIRP

Worst Test Graphs

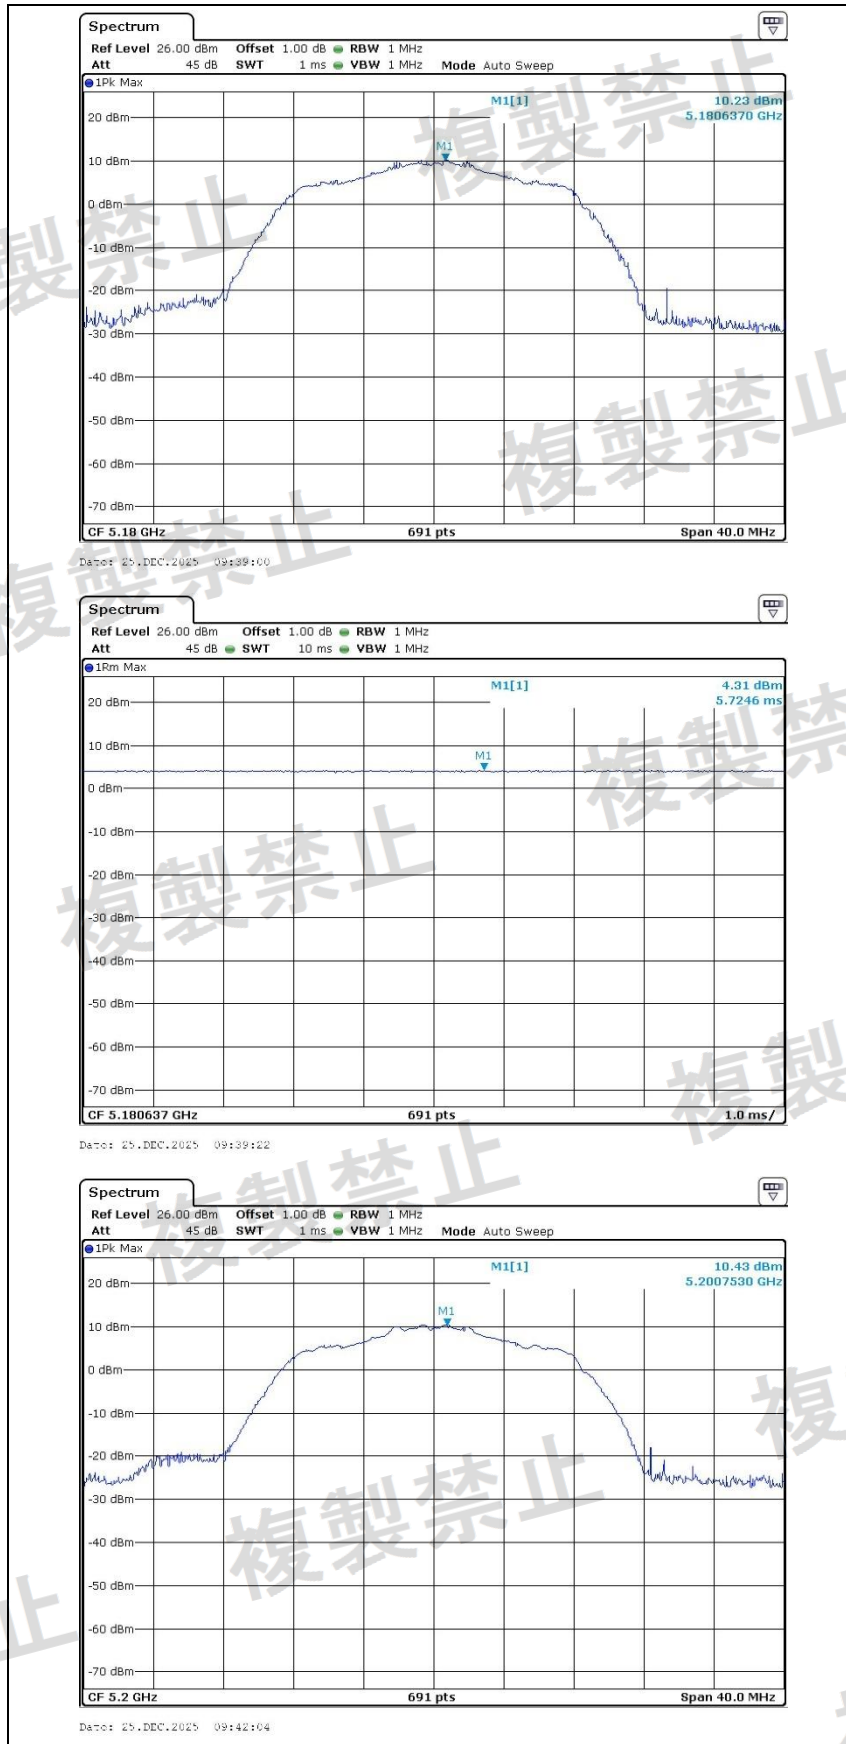

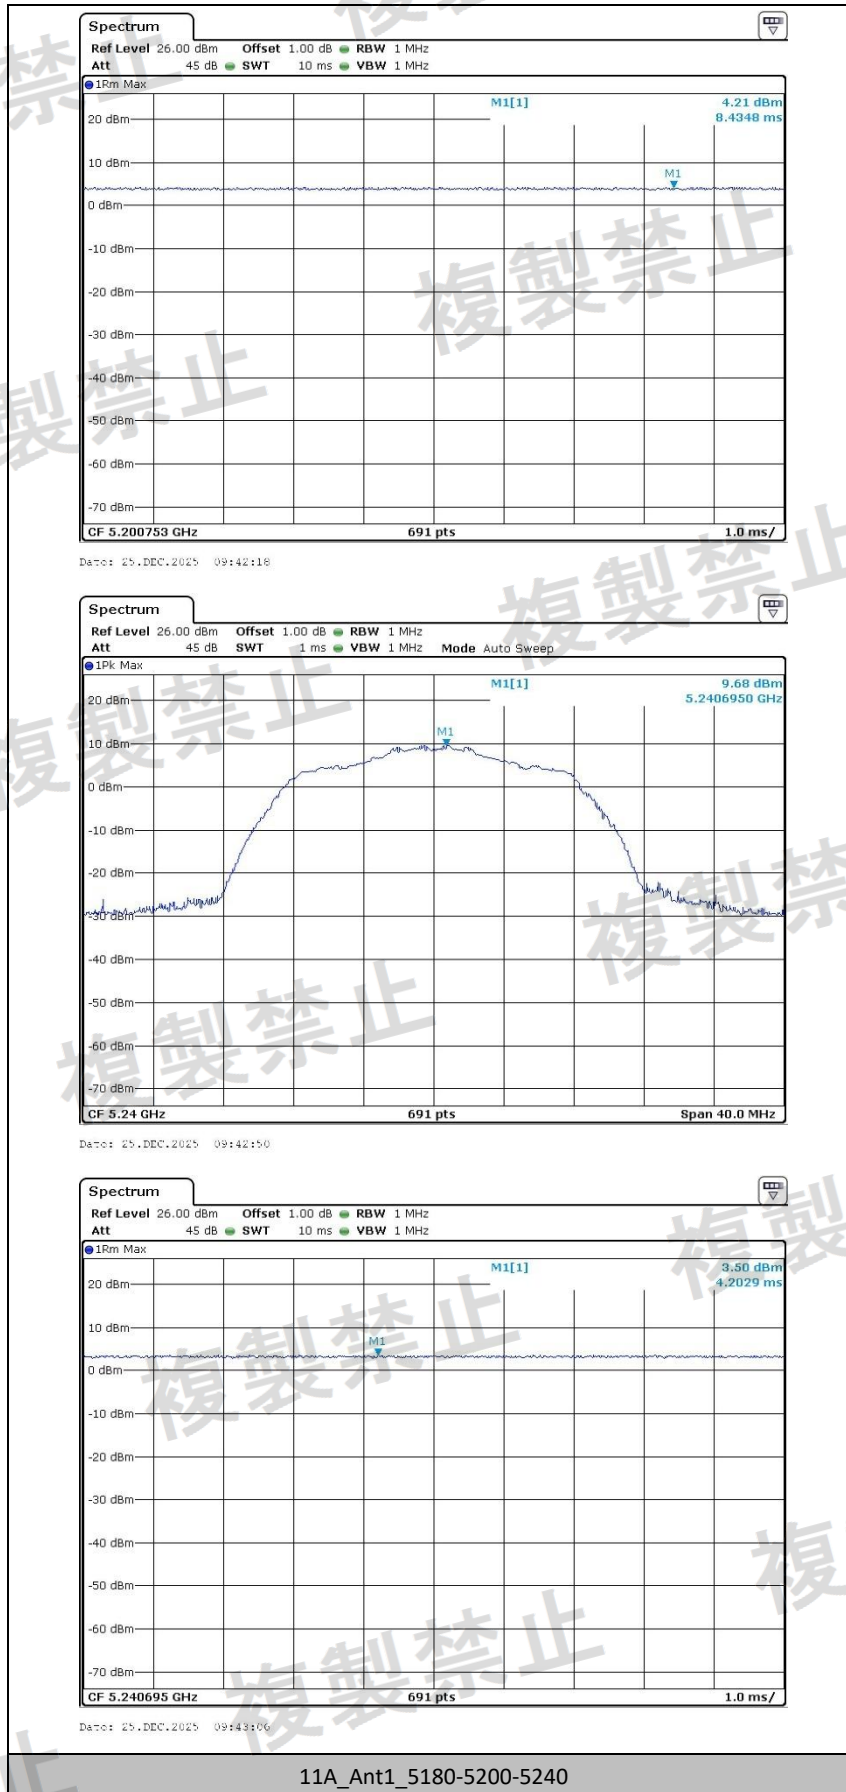



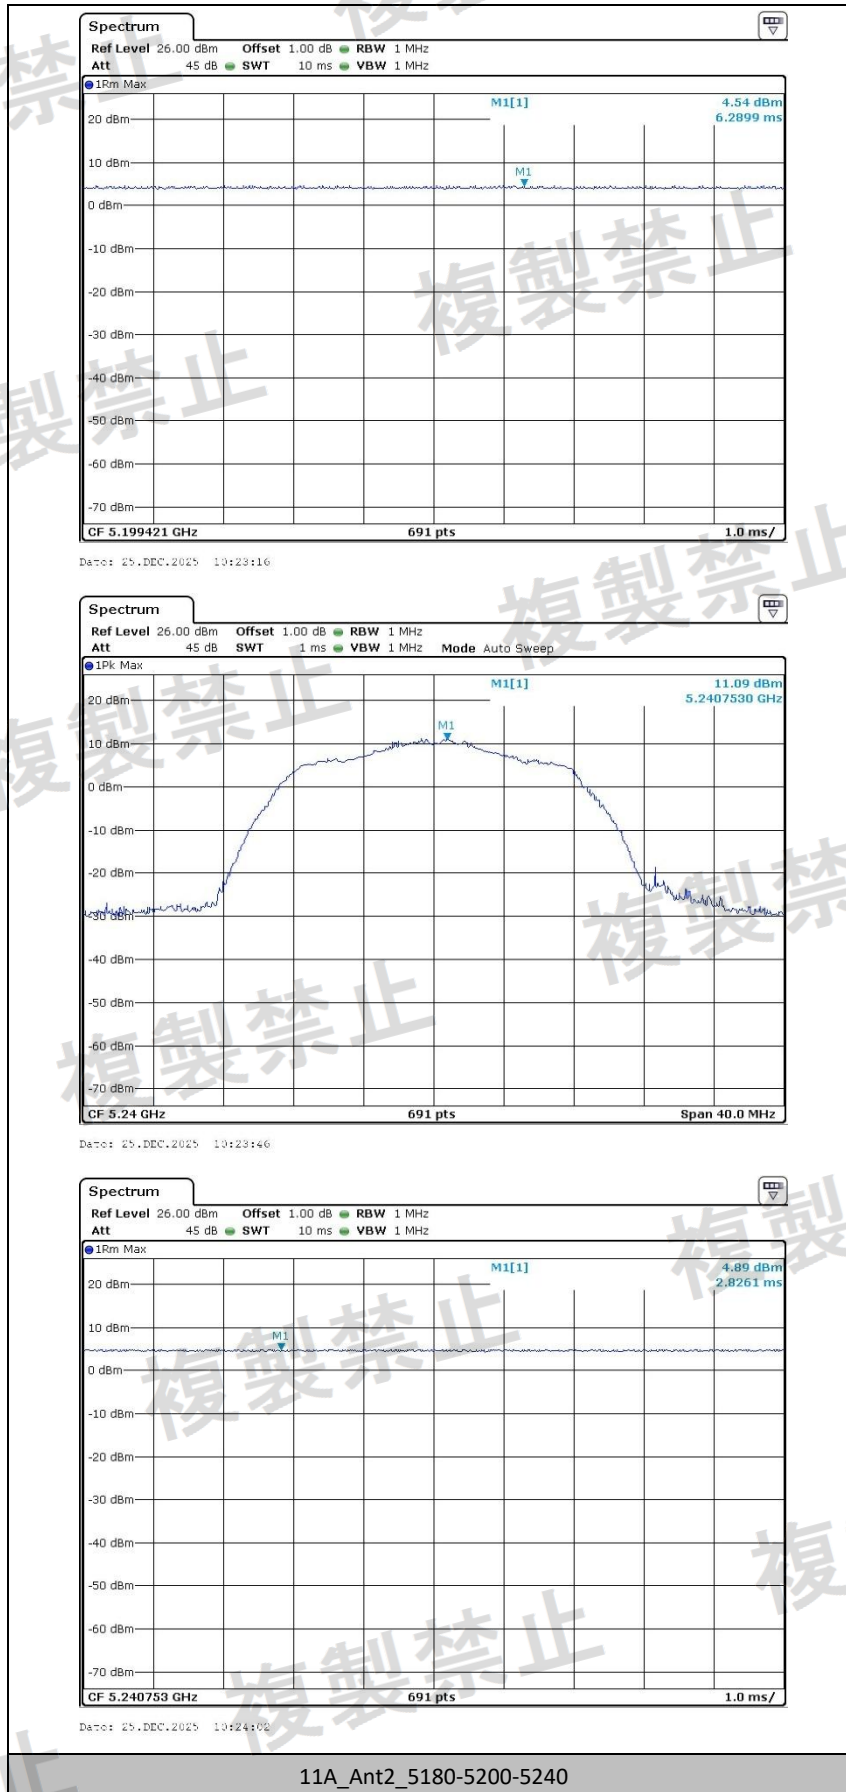

11A_Ant2_5180-5200-5240

