








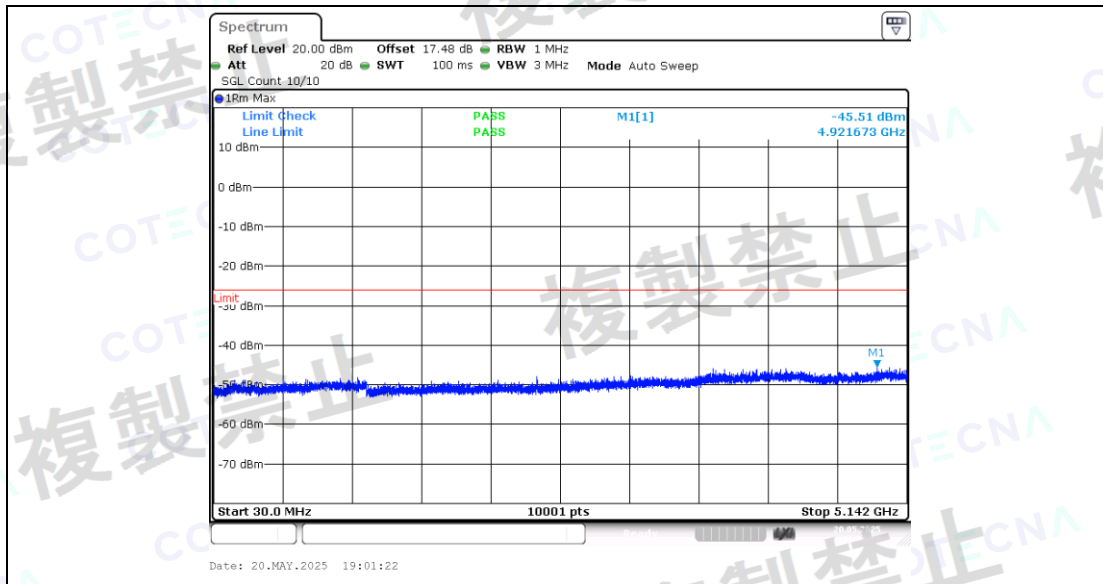

NTHV_11AC20SISO_Ant1_5240_5142~5150

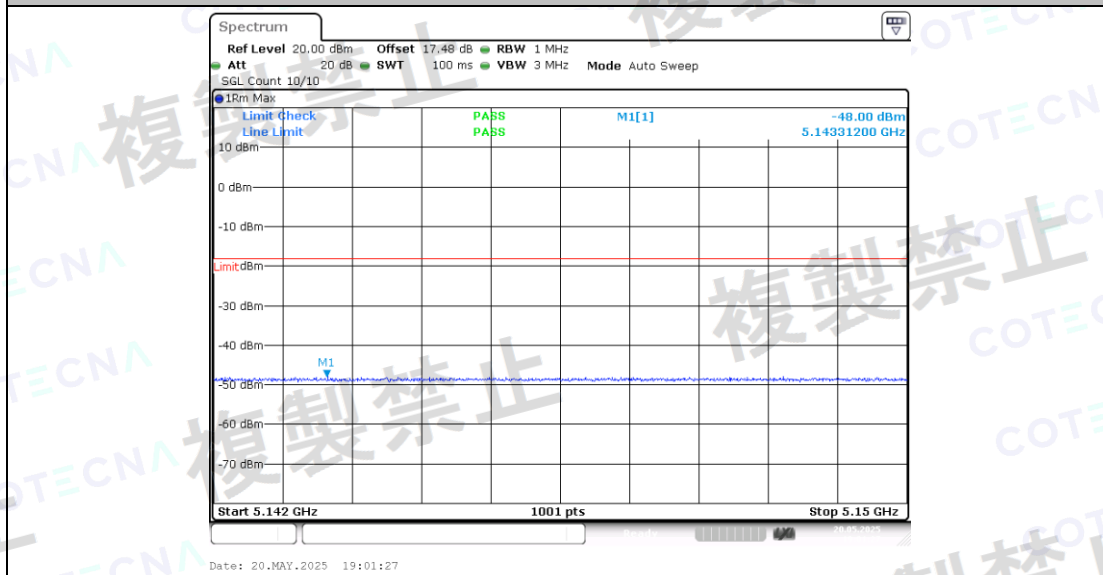


NTHV_11AC20SISO_Ant1_5240_5250~5250.2

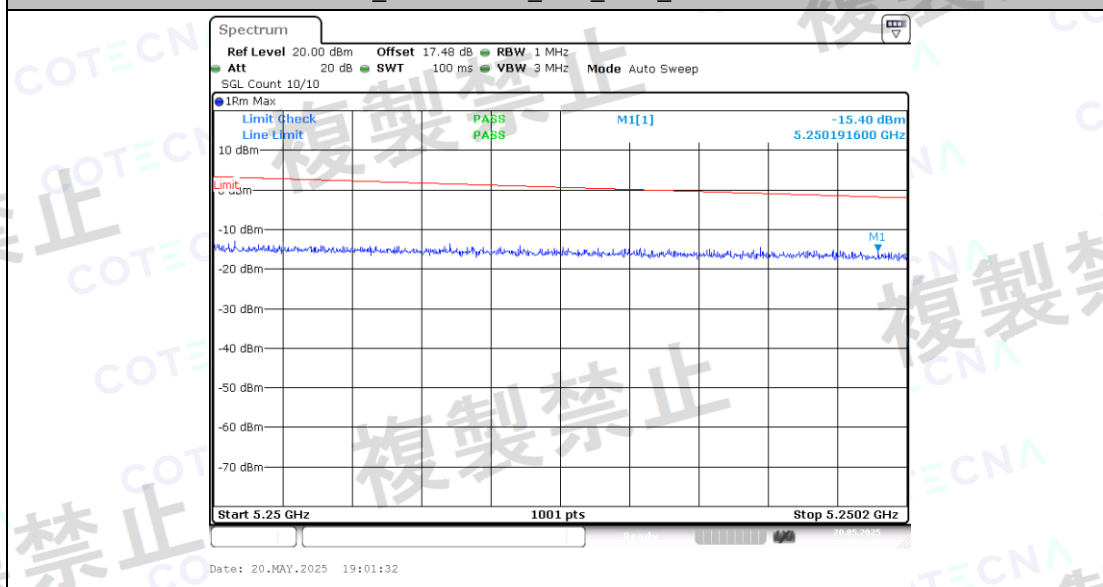


NTHV_11AC20SISO_Ant1_5240_5250.2~5251




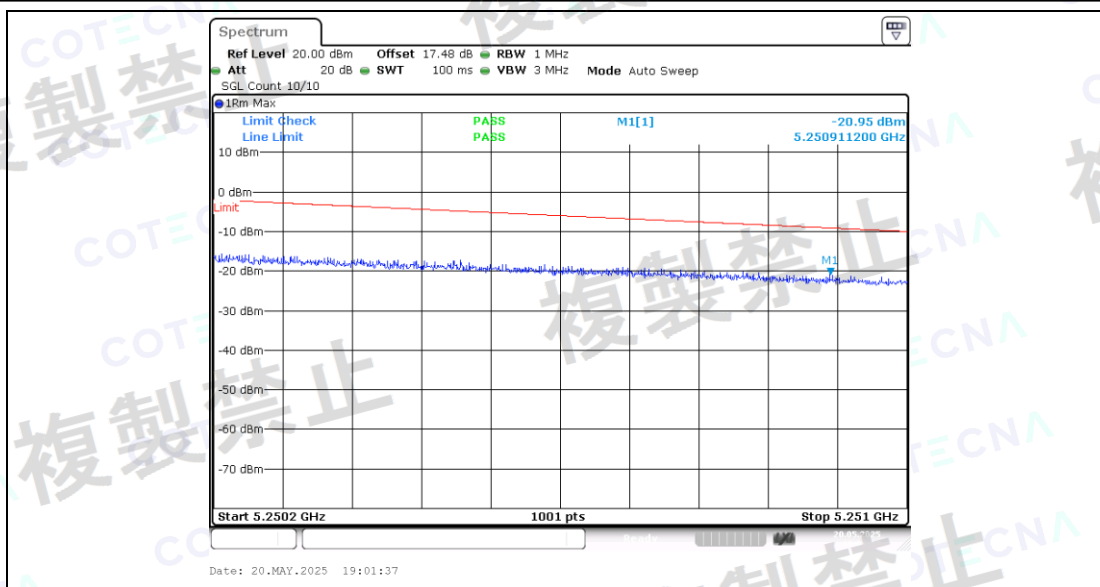

NTHV_11AC20SISO_Ant1_5240_5251~5260

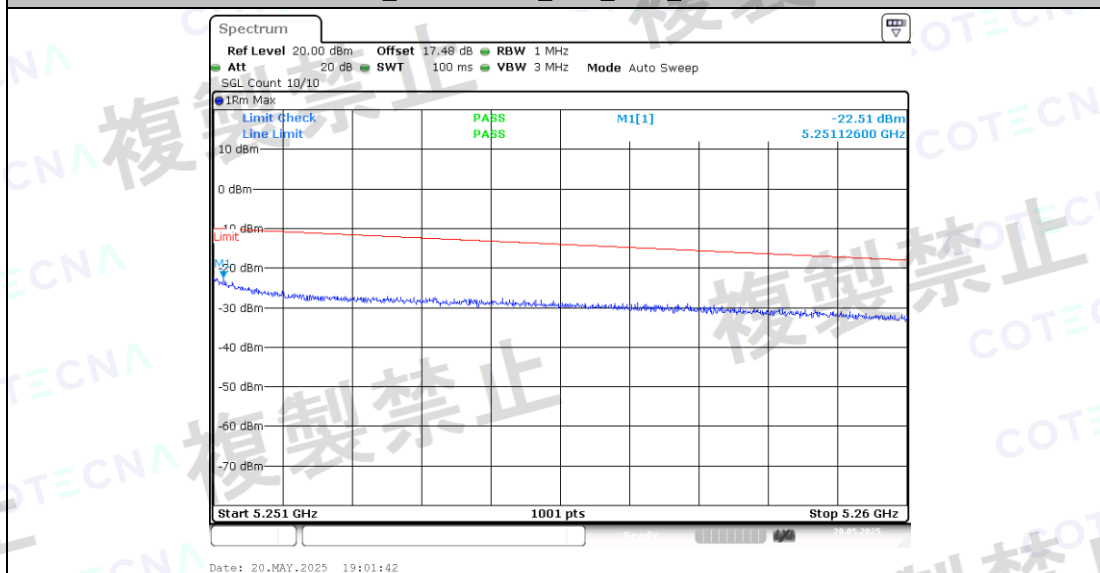


NTHV_11AC20SISO_Ant1_5240_5260~5266.7

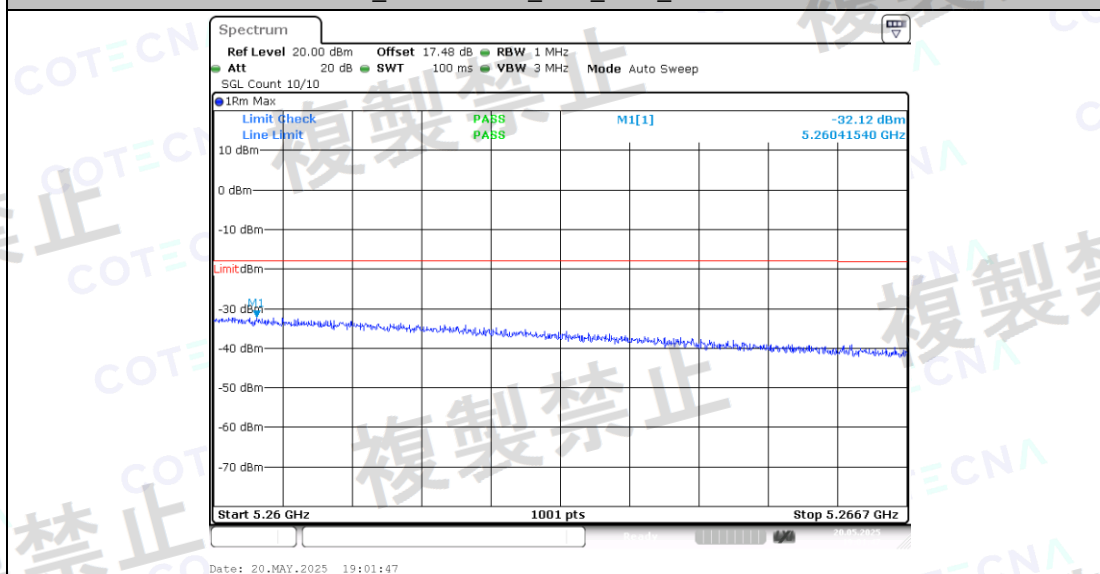


NTHV_11AC20SISO_Ant1_5240_5266.7~26000




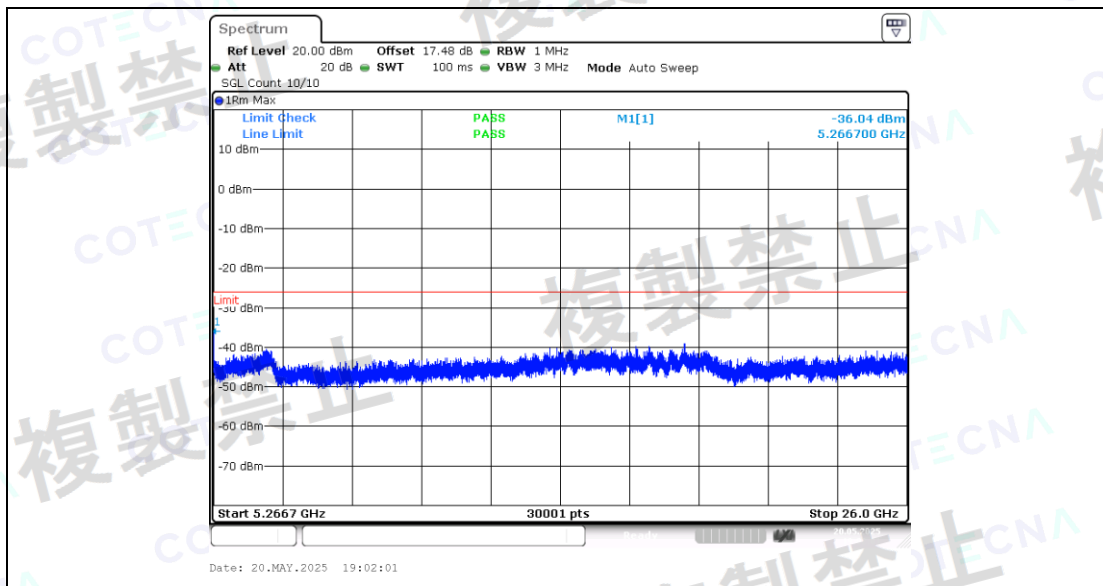

NTHV_11AC20SISO_Ant1_5260_30~5233.3

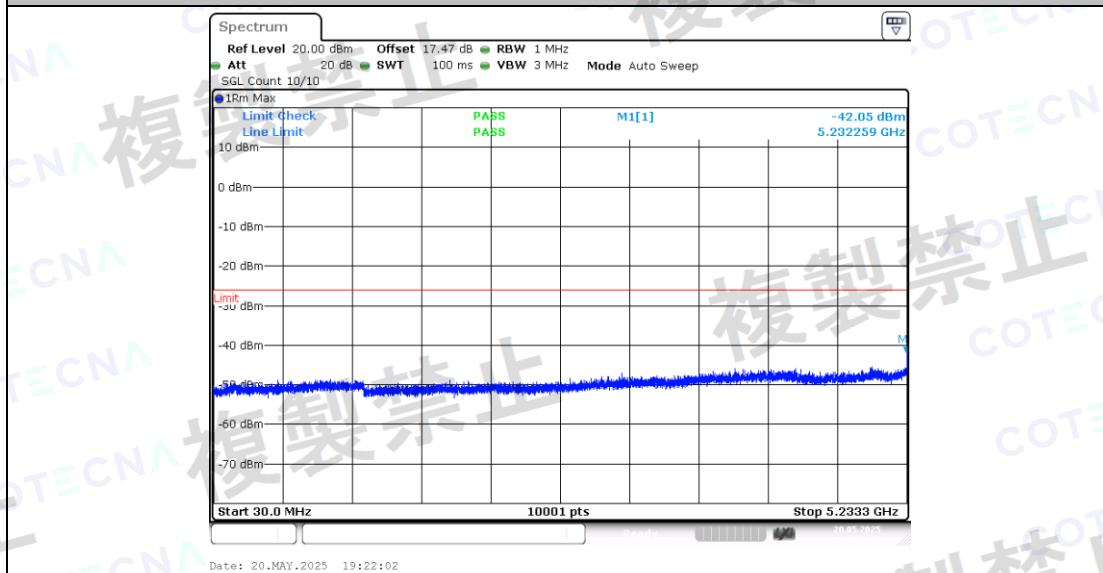


NTHV_11AC20SISO_Ant1_5260_5233.3~5240

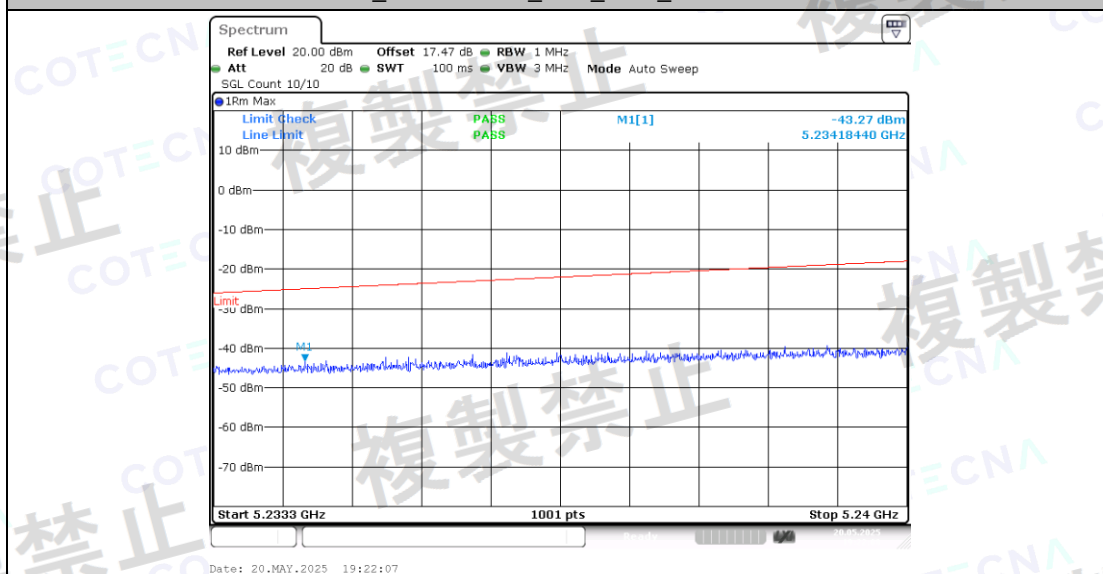


NTHV_11AC20SISO_Ant1_5260_5240~5249




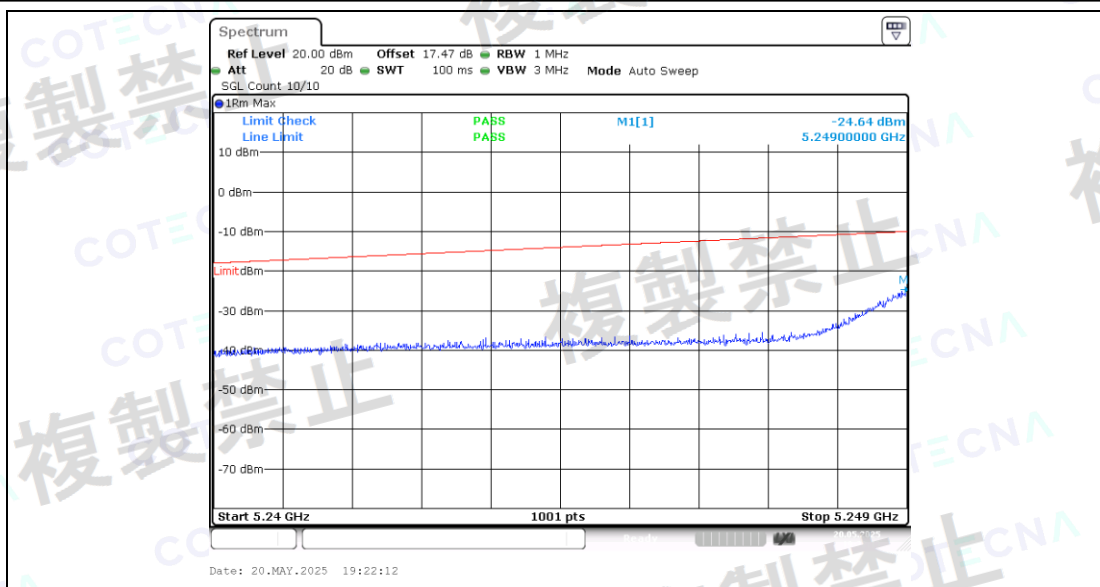

NTHV_11AC20SISO_Ant1_5260_5249~5250

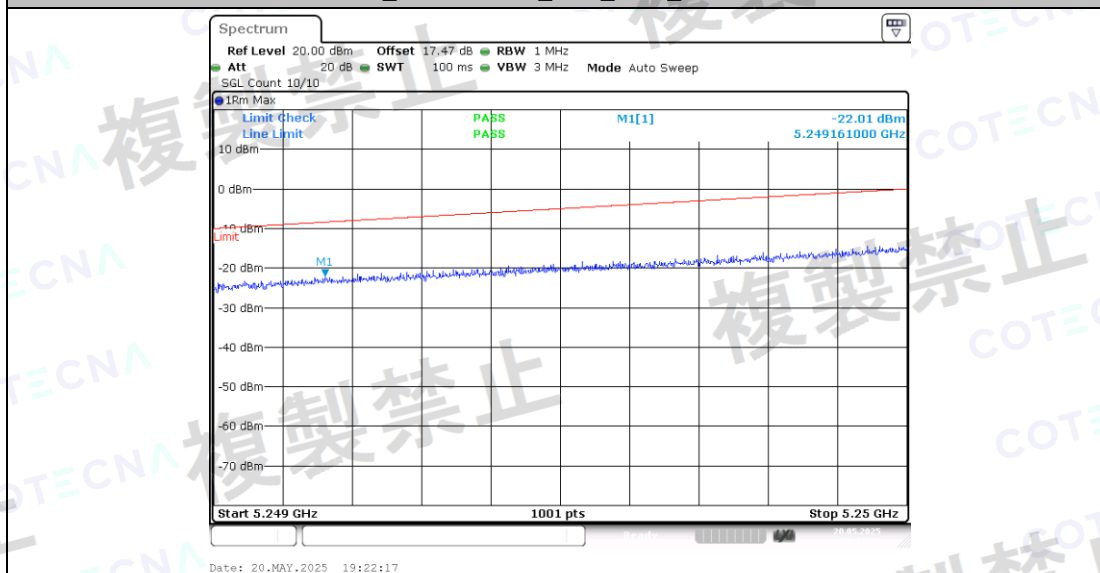

NTHV_11AC20SISO_Ant1_5260_5350~26000

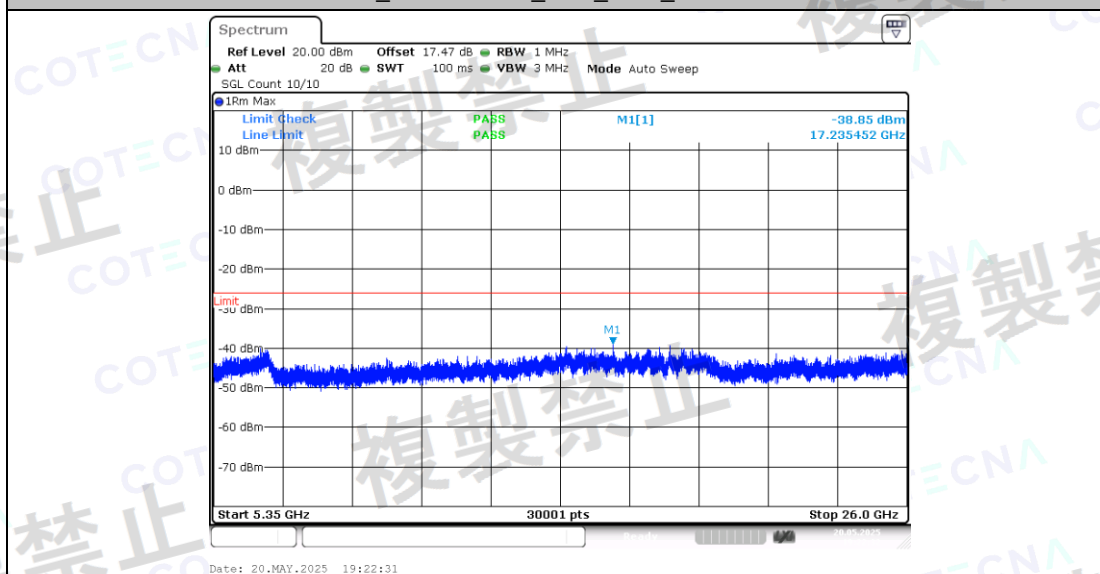


NTHV_11AC20SISO_Ant1_5280_30~5233.3









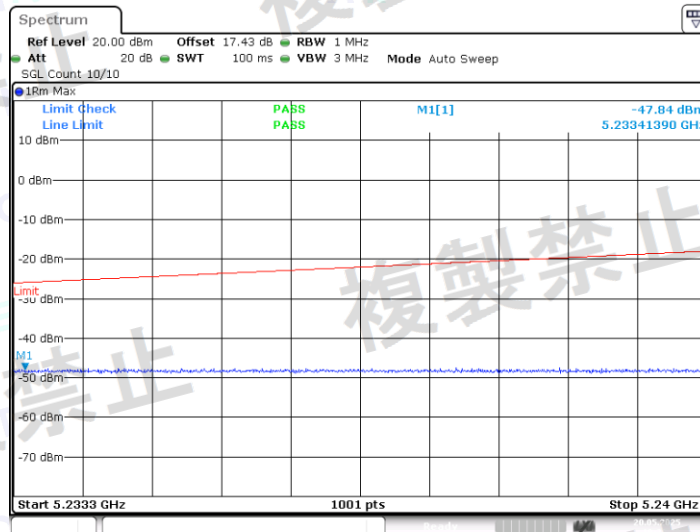

NTHV_11AC20SISO_Ant1_5300_5240~5249

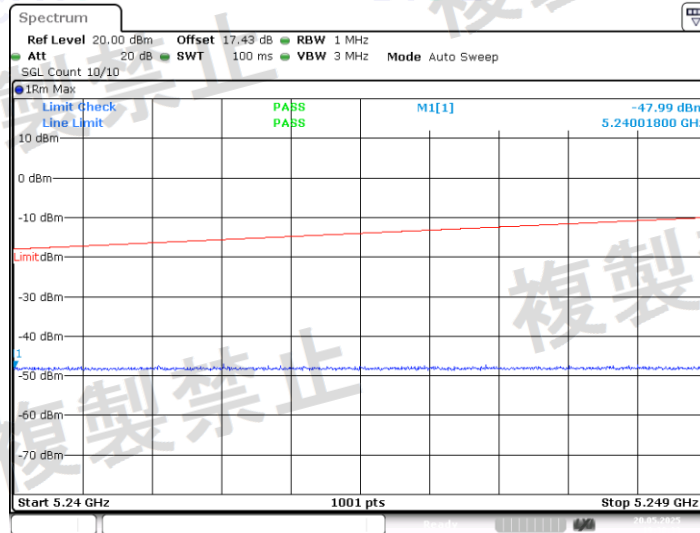


NTHV_11AC20SISO_Ant1_5300_5249~5250

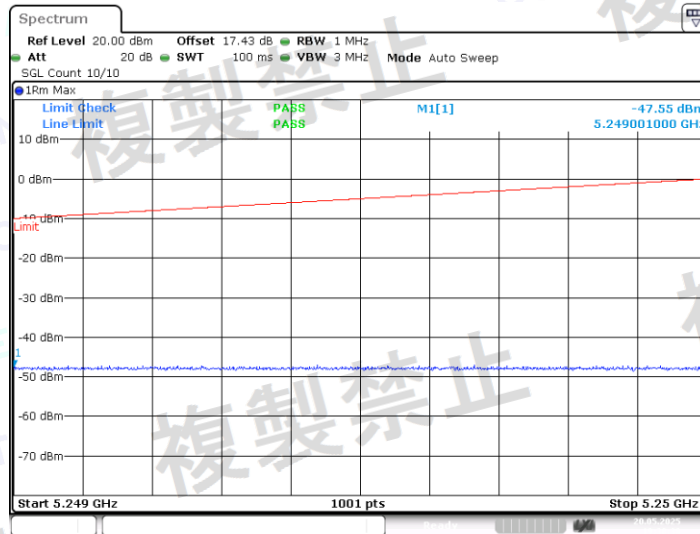


NTHV 11AC20SISO Ant1 5300 5350~26000






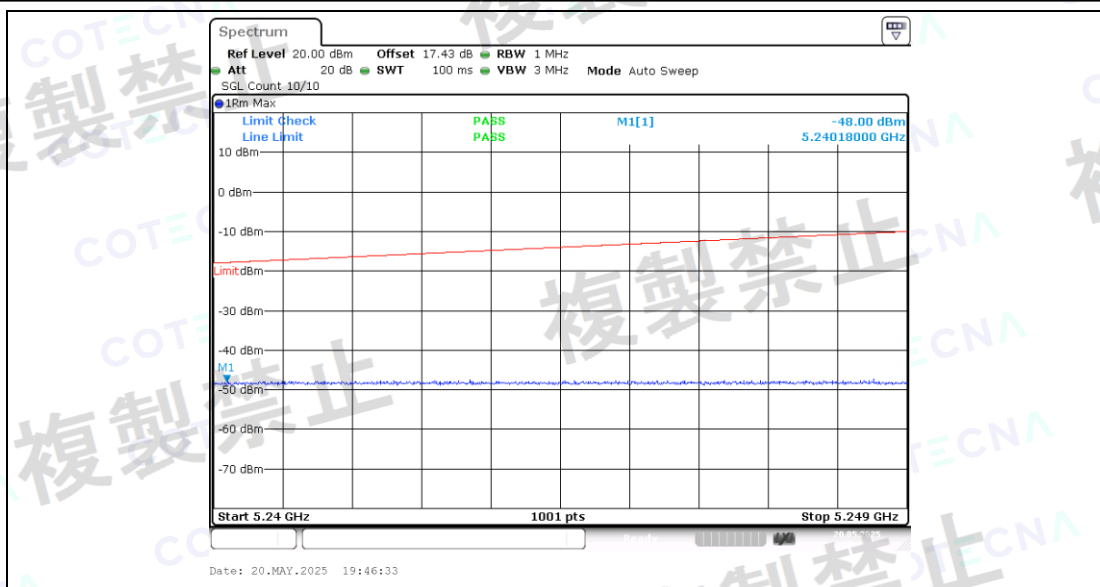

NTHV_11AC20SISO_Ant1_5320_5249~5250

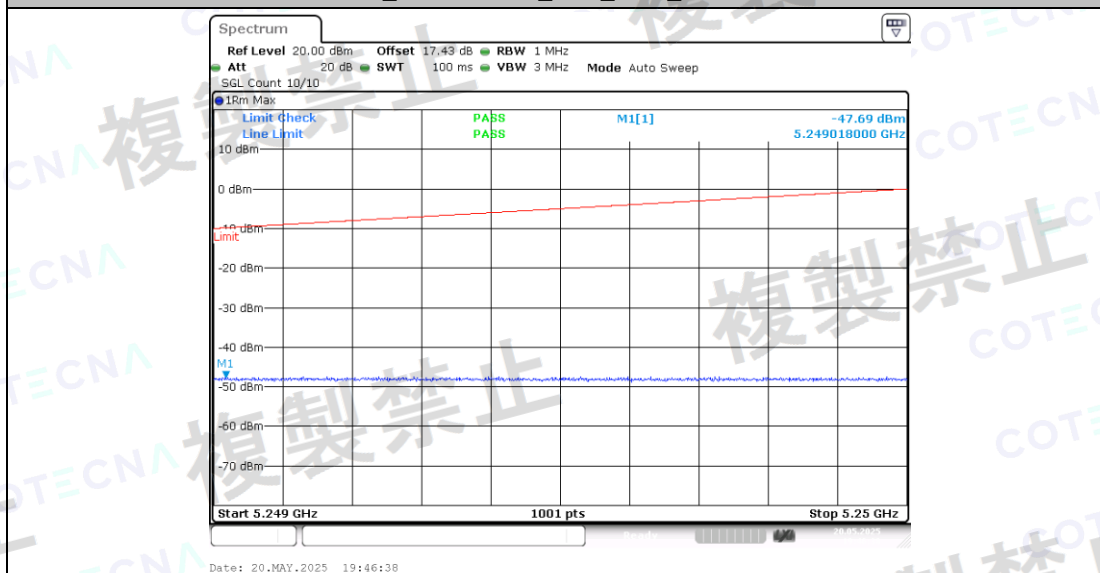


NTHV_11AC20SISO_Ant1_5320_5350~26000

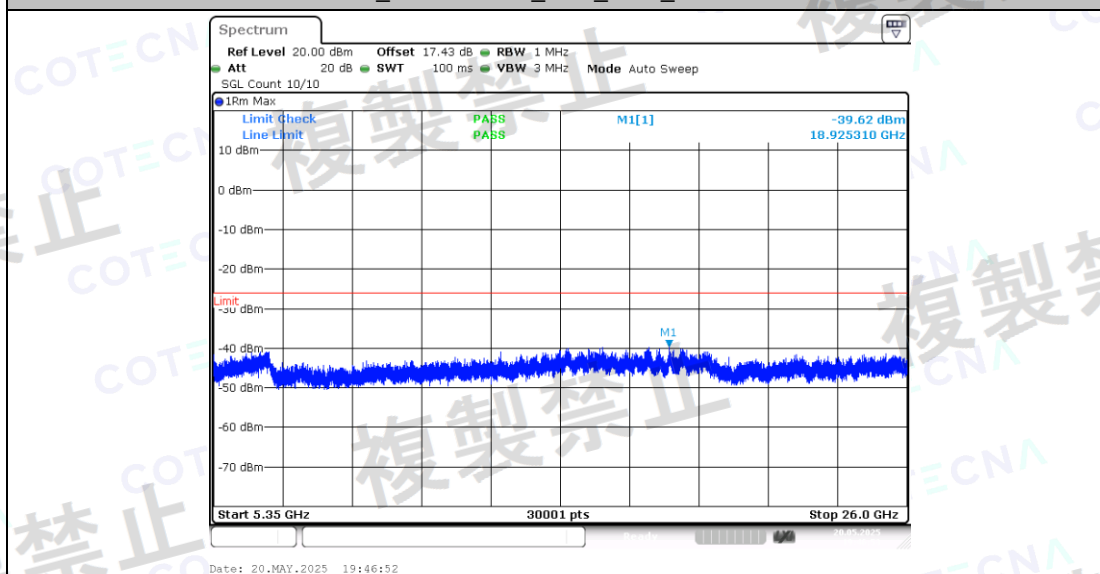


NTHV_11AC20SISO_Ant1_5500_30~5460




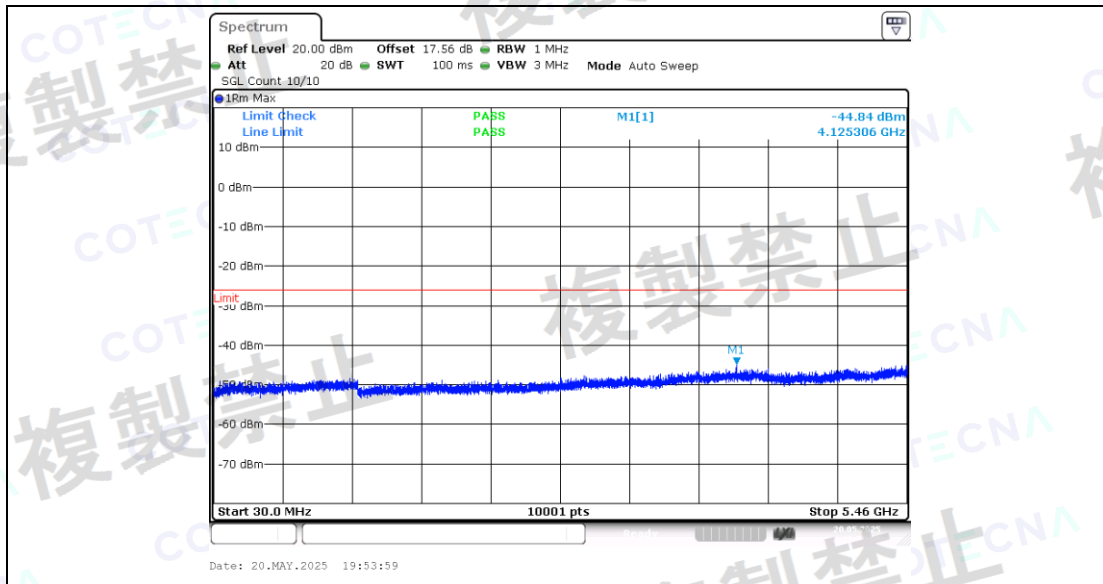

NTHV_11AC20SISO_Ant1_5500_5460~5470

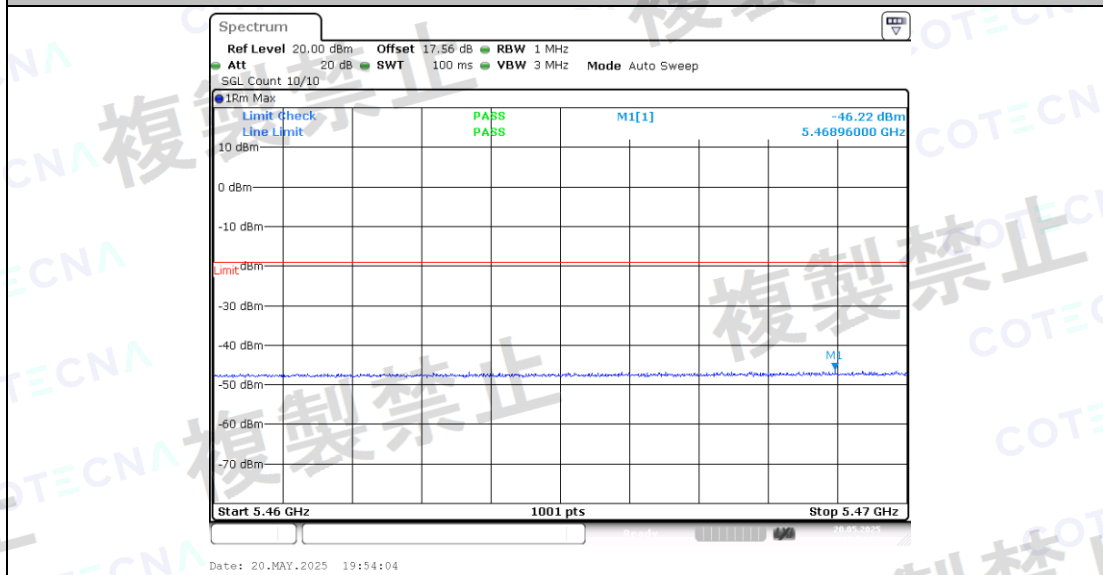



NTHV_11AC20SISO_Ant1_5500_5745~5765

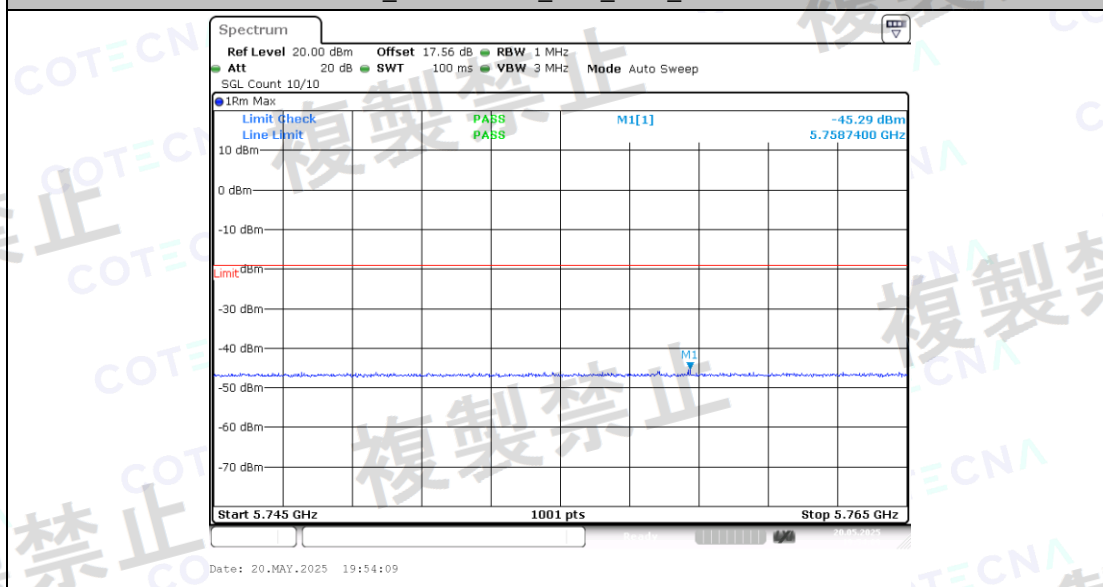


NTHV_11AC20SISO_Ant1_5500_5765~26000




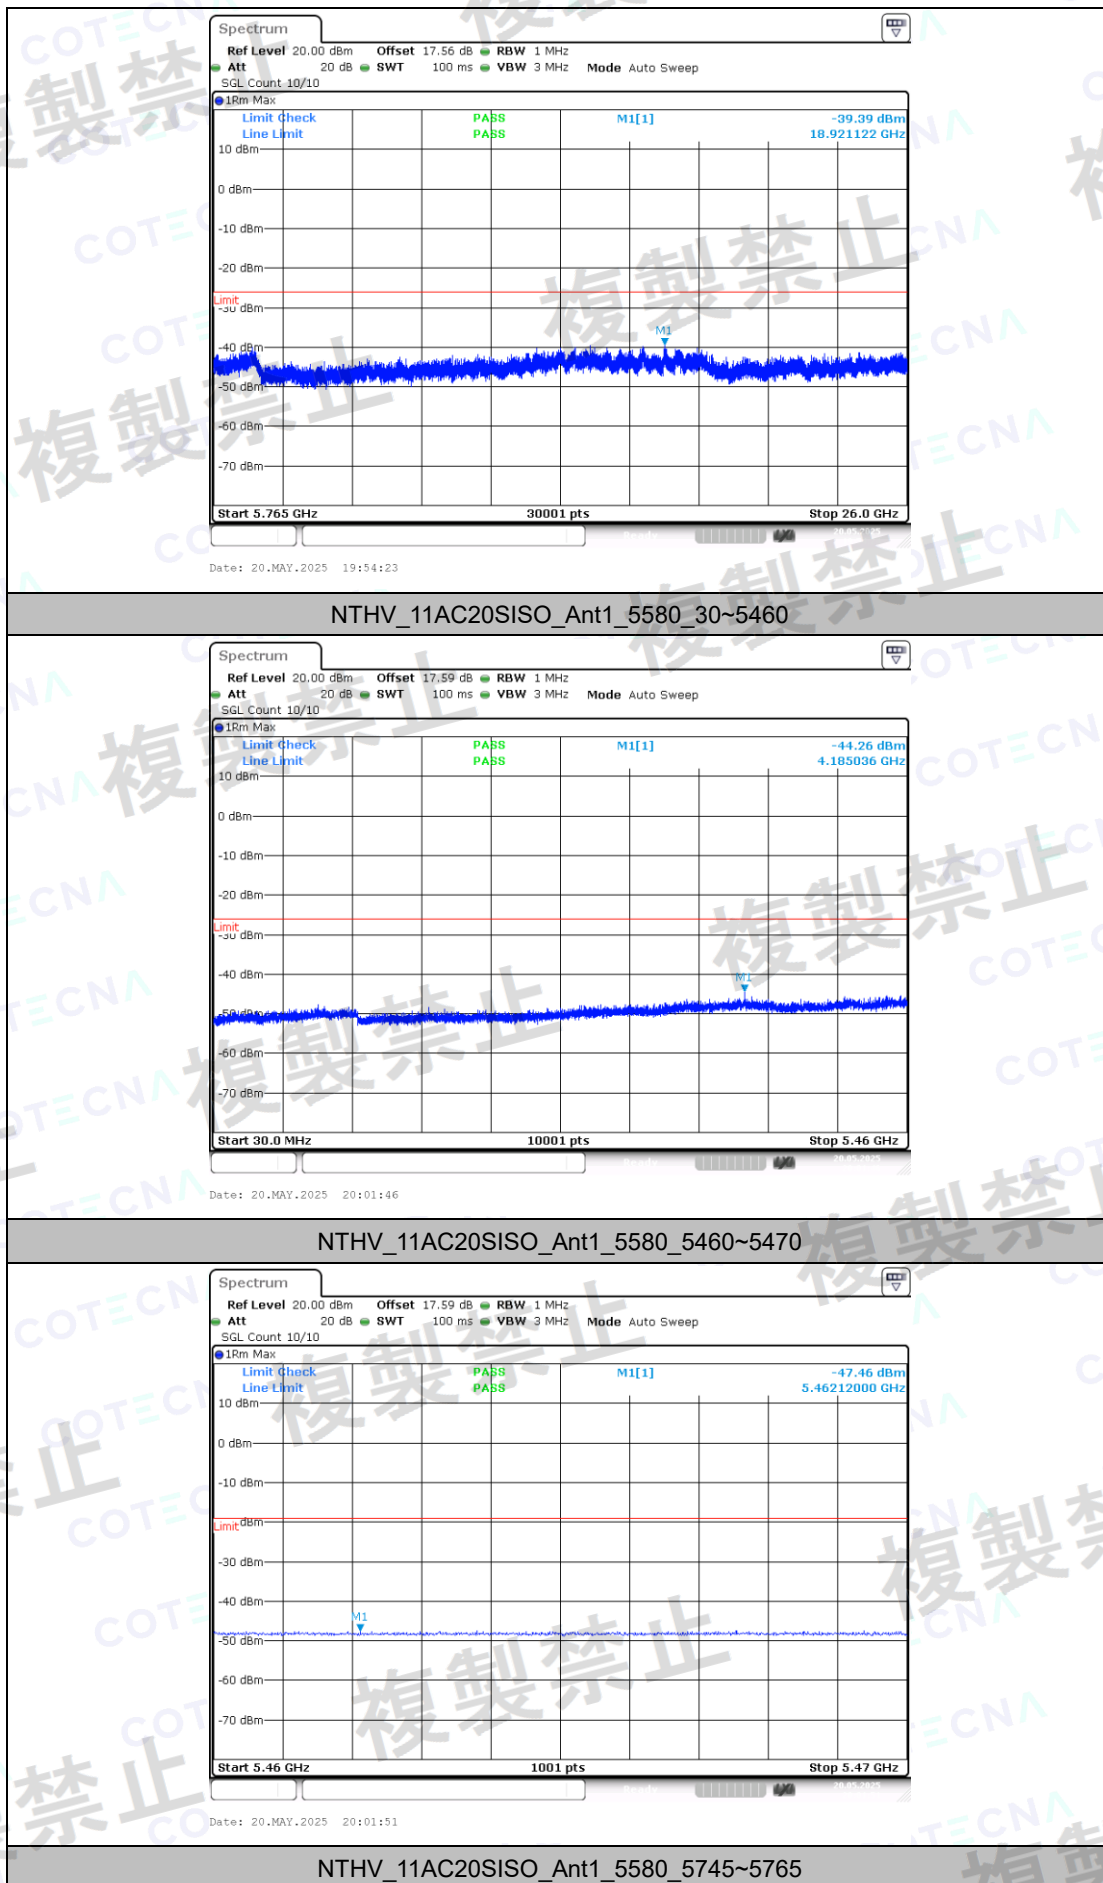

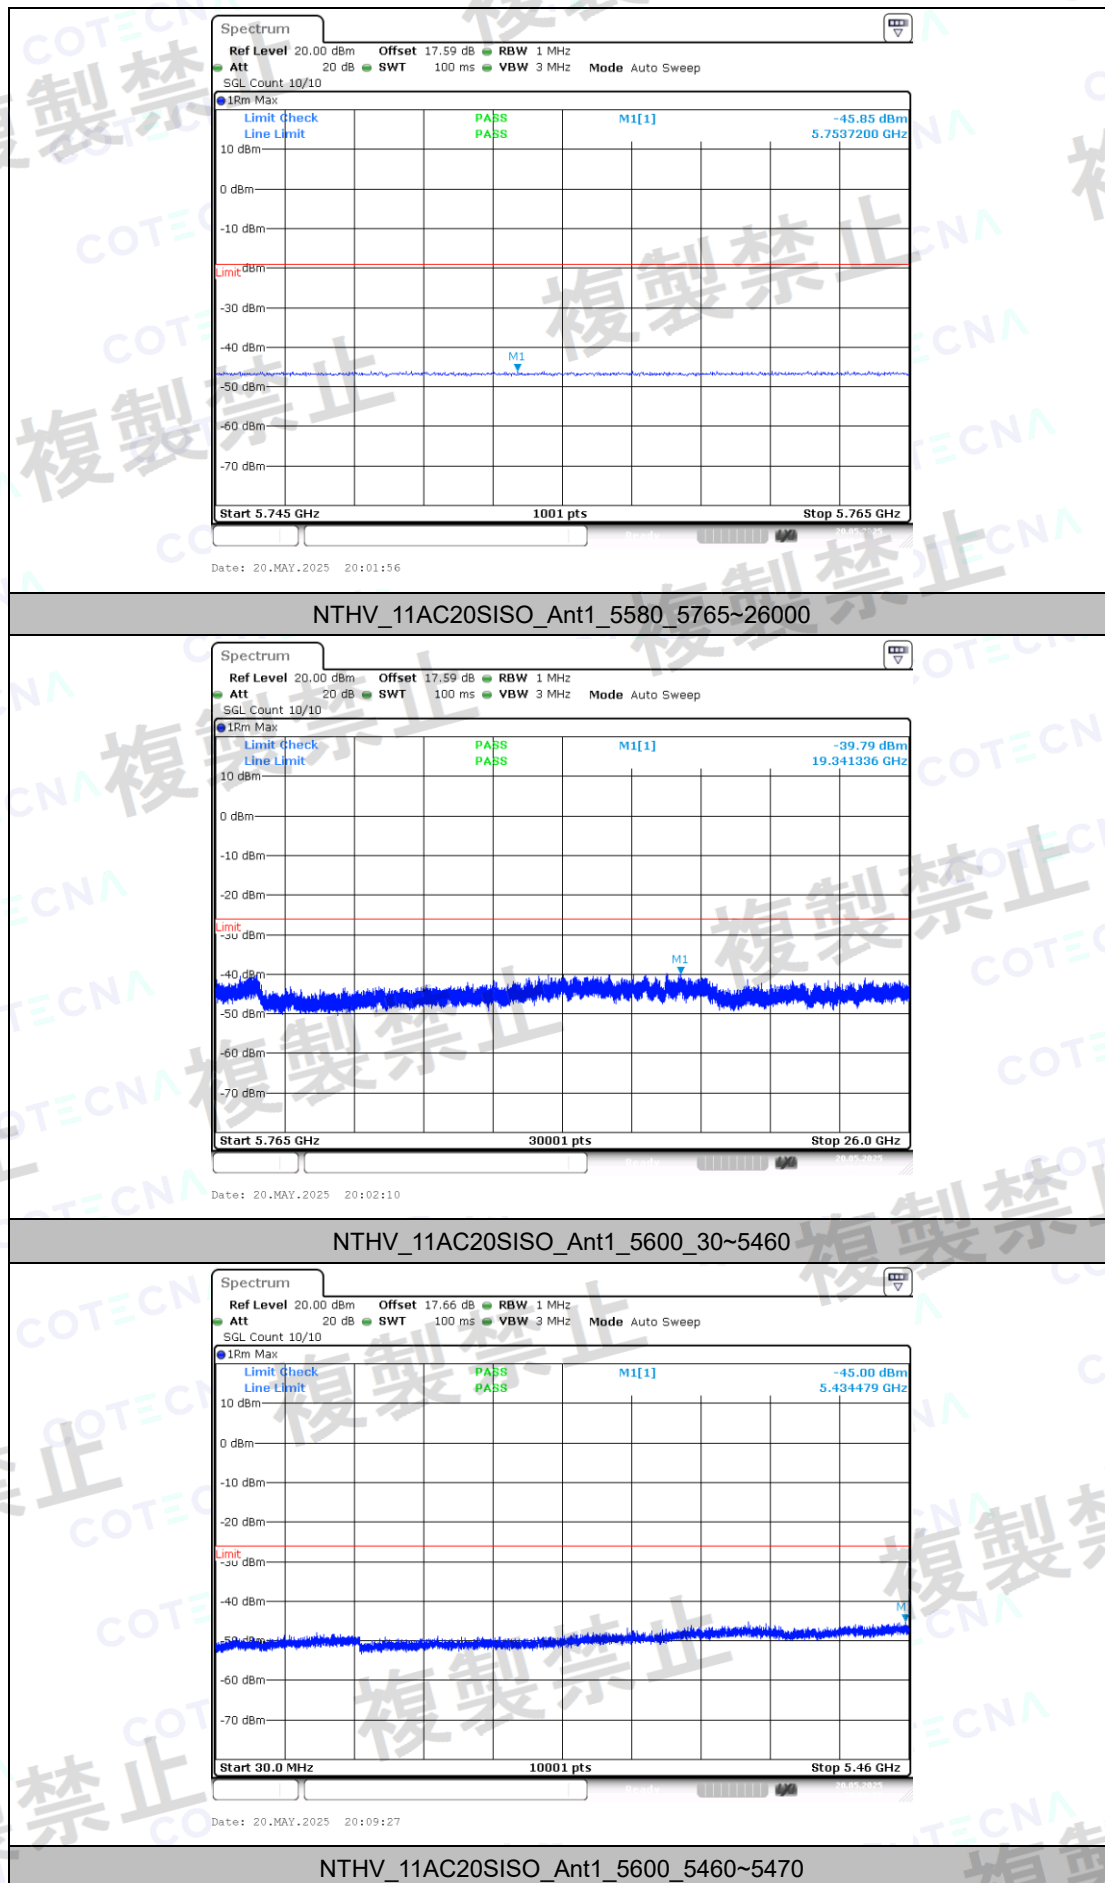


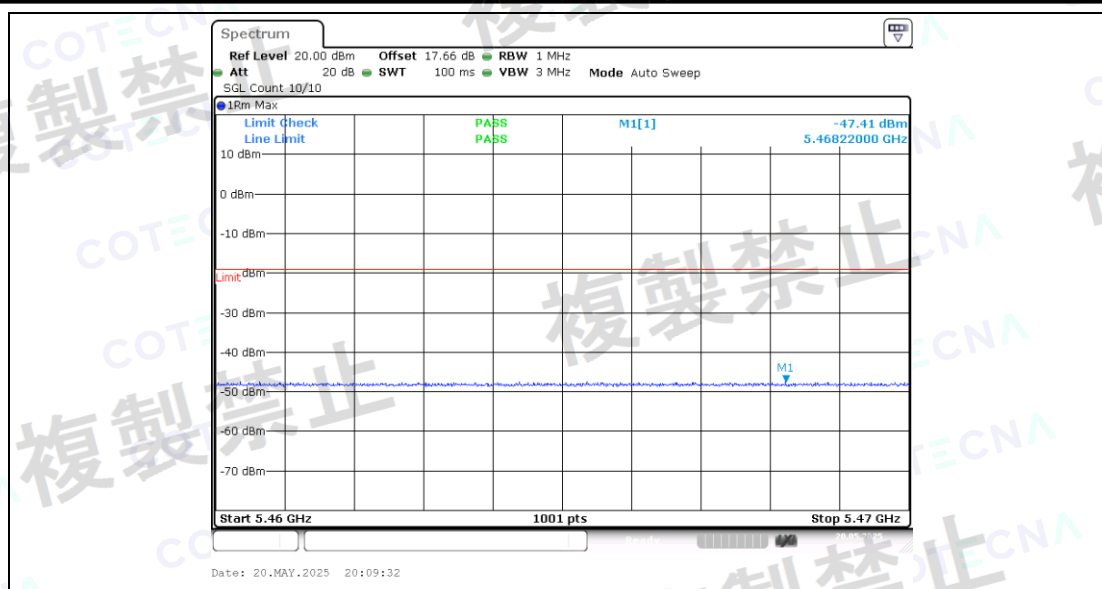

NTHV_11AC20SISO_Ant1_5600_5745~5765

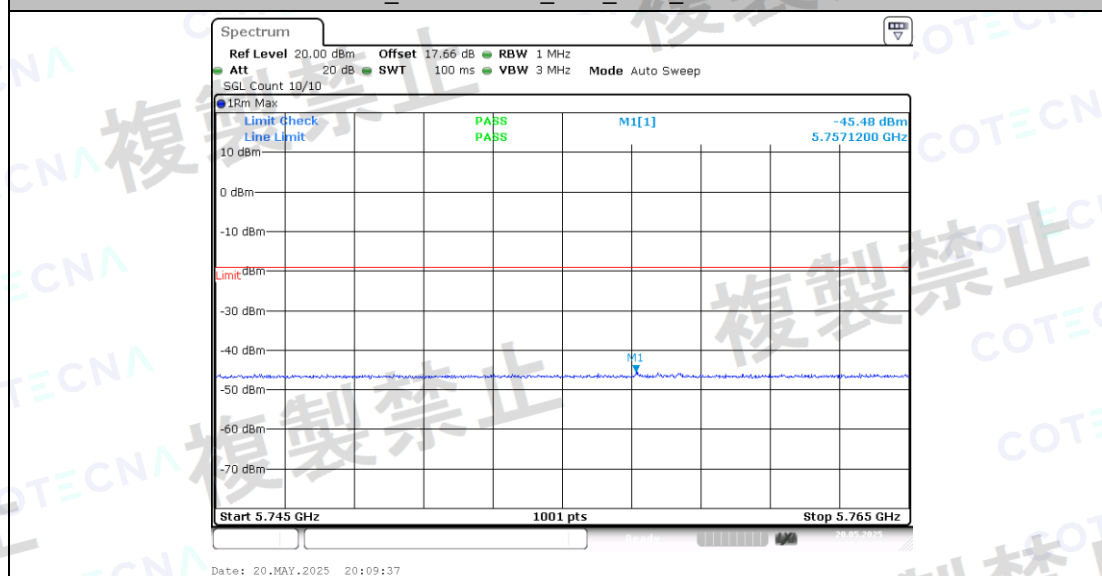

NTHV_11AC20SISO_Ant1_5600_5765~26000

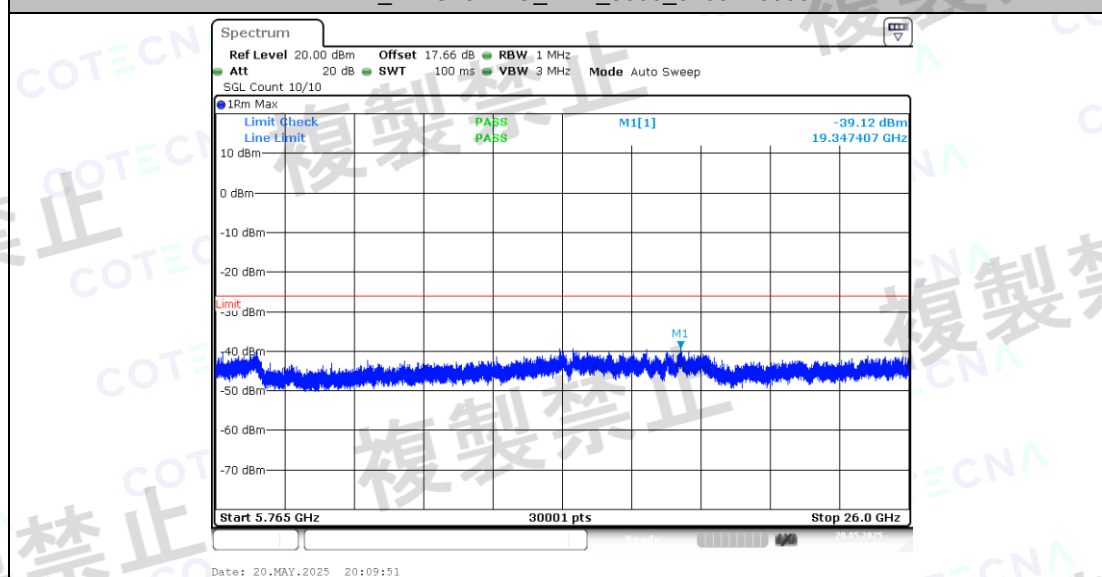


NTHV_11AC20SISO_Ant1_5700_30~5460











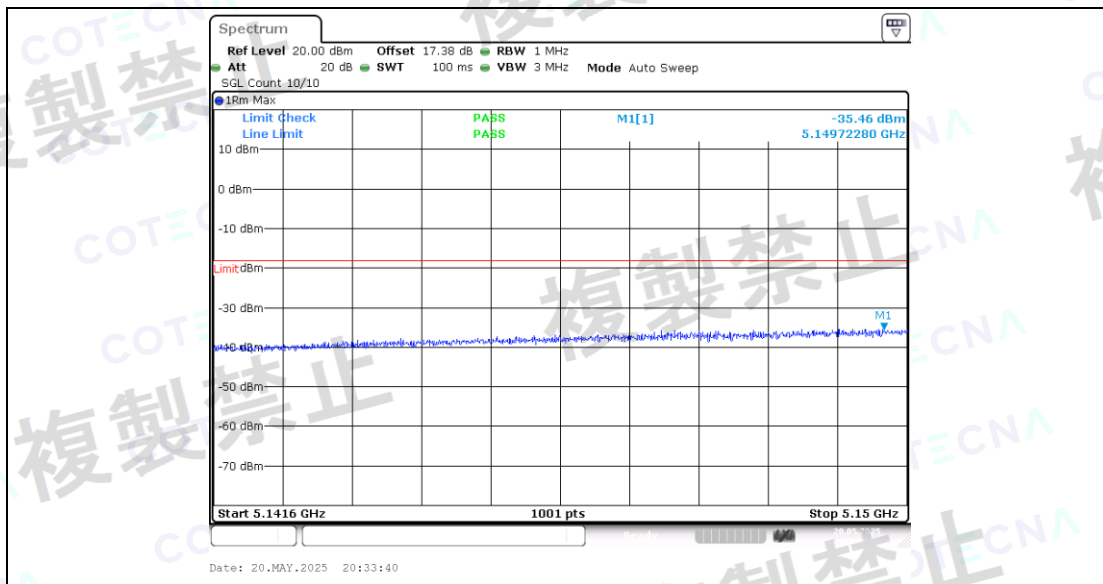

NTHV_11AC40SISO_Ant1_5190_5250~5251

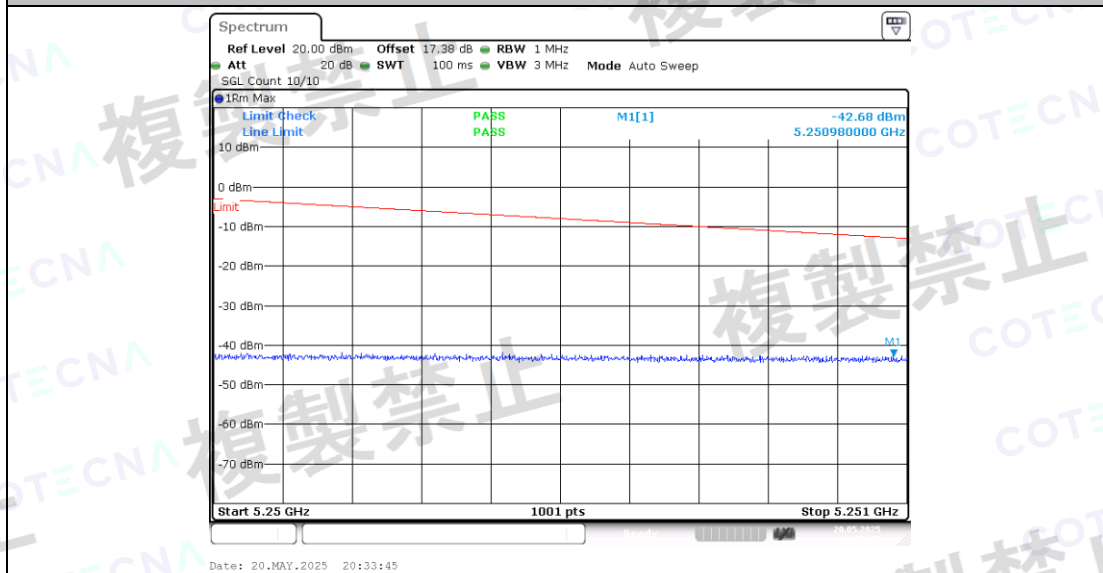


NTHV_11AC40SISO_Ant1_5190_5251~5270

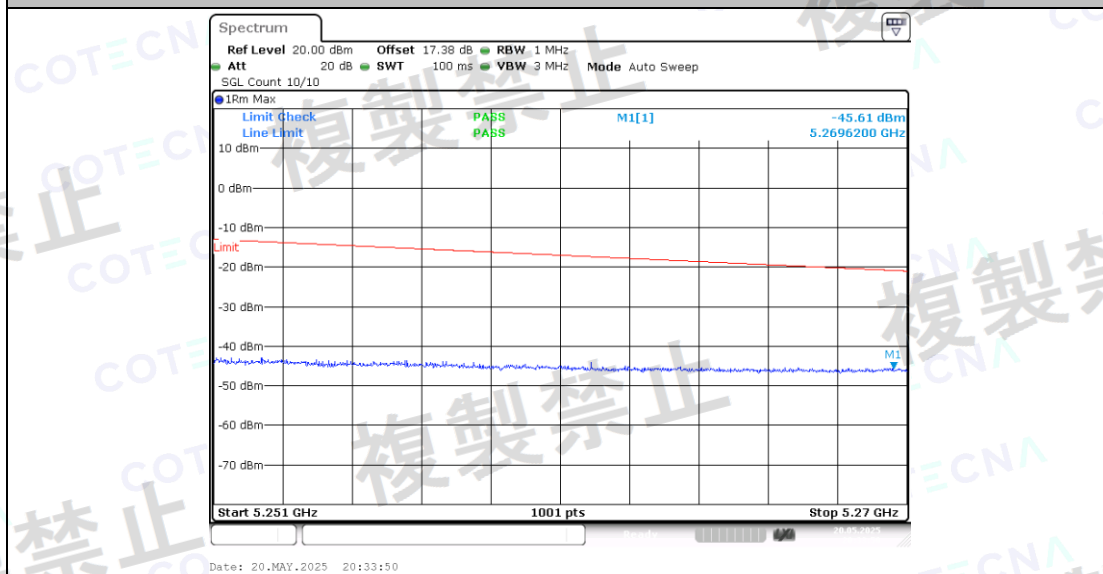



NTHV_11AC40SISO_Ant1_5190_5270~5278.4



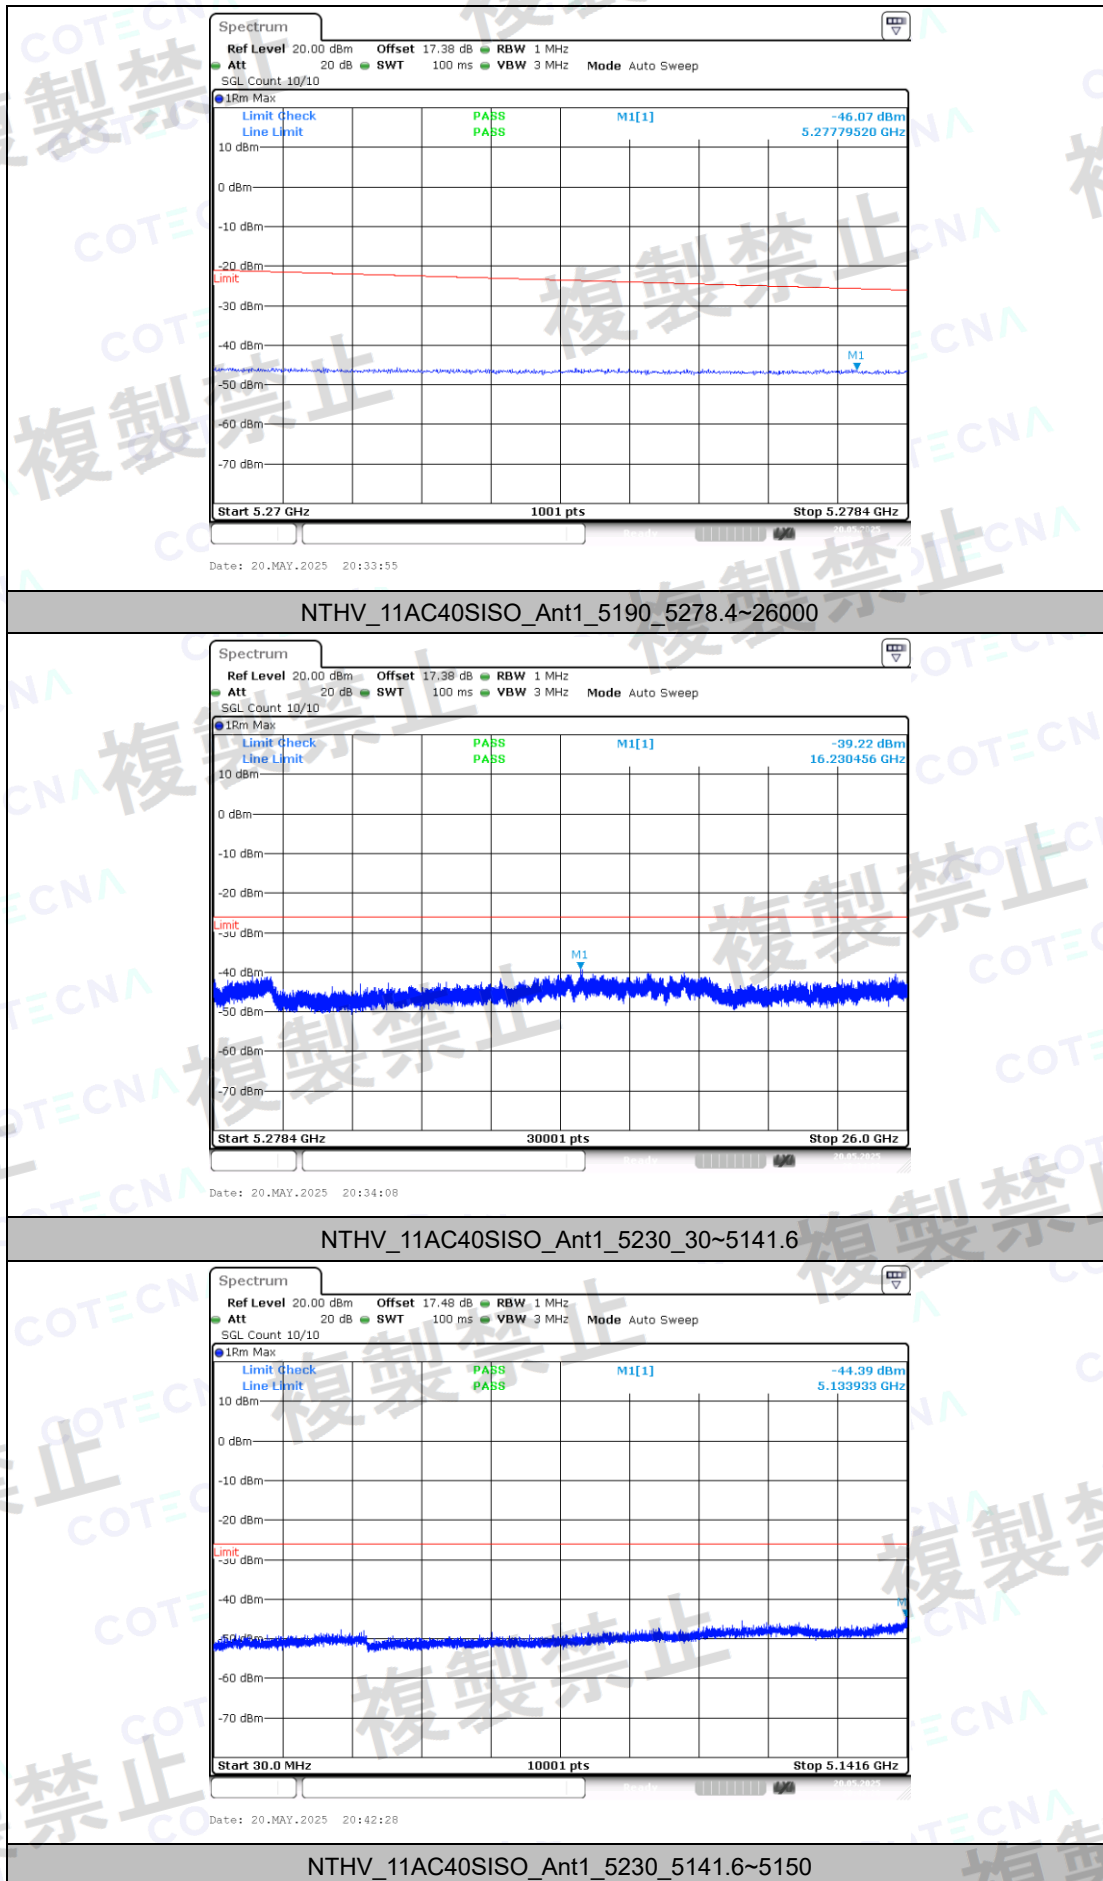



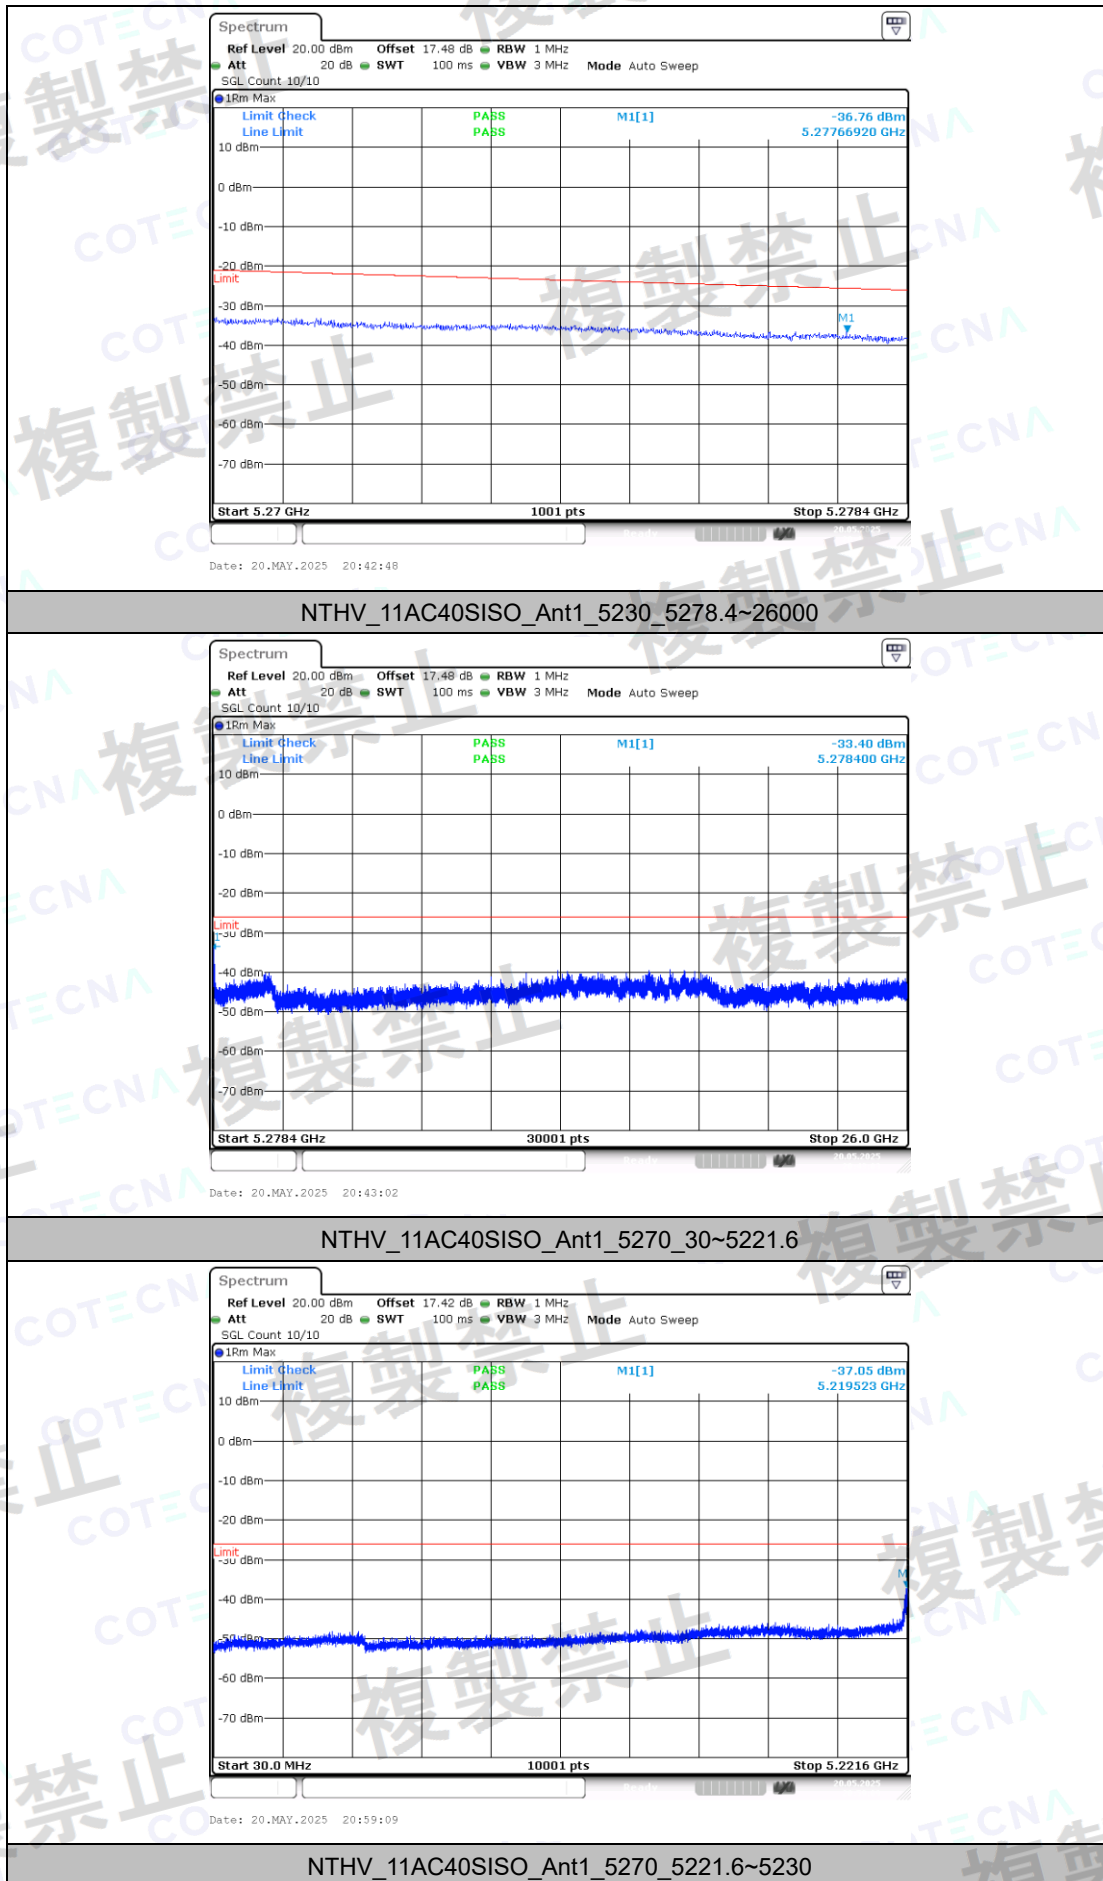


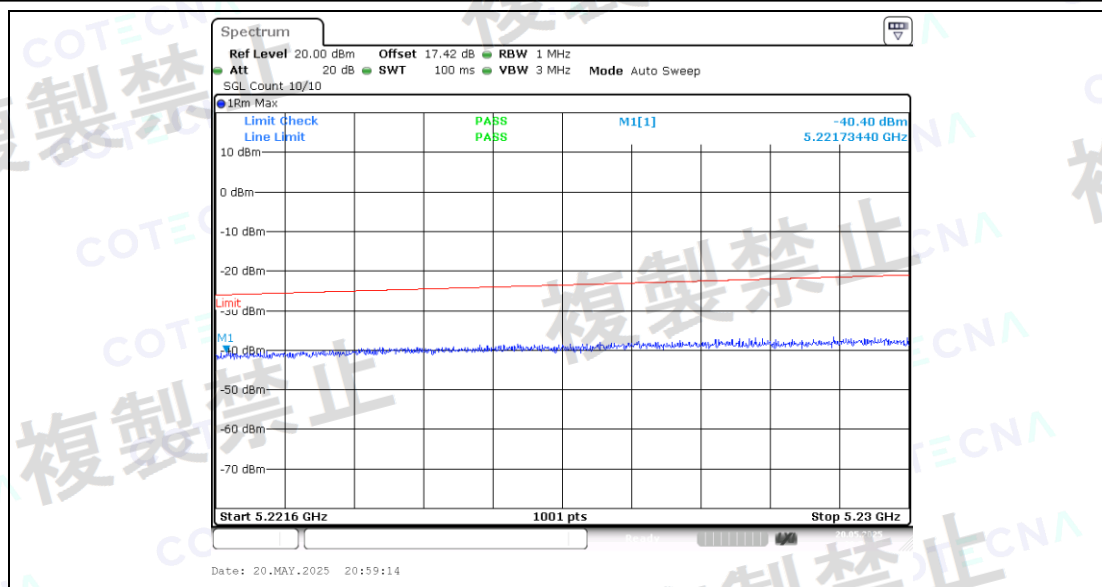

NTHV_11AC40SISO_Ant1_5270_5230~5249



NTHV_11AC40SISO_Ant1_5270_5249~5250

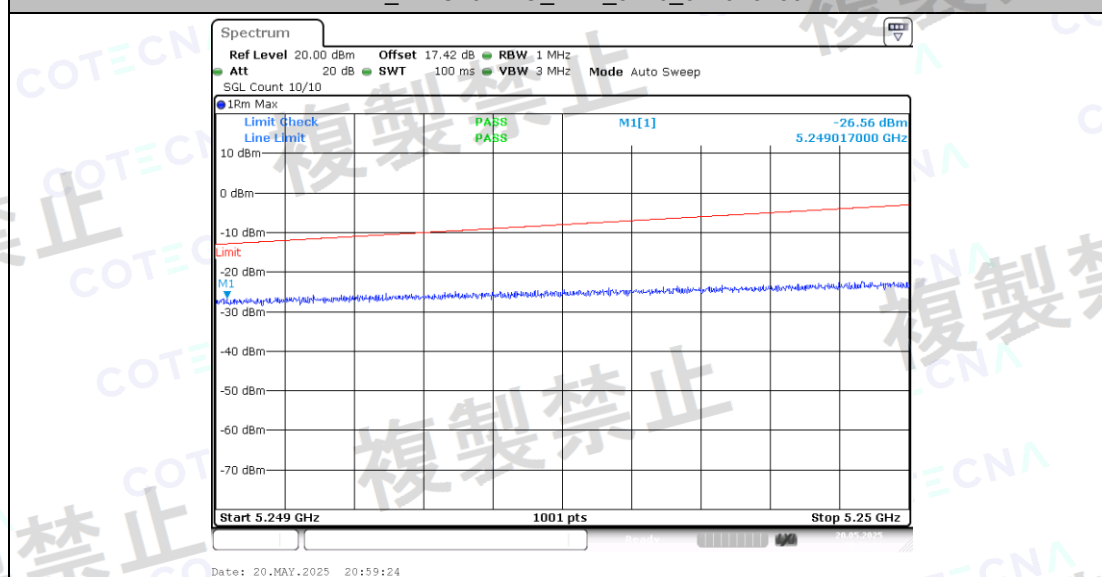


NTHV_11AC40SISO_Ant1_5270_5348.4~26000









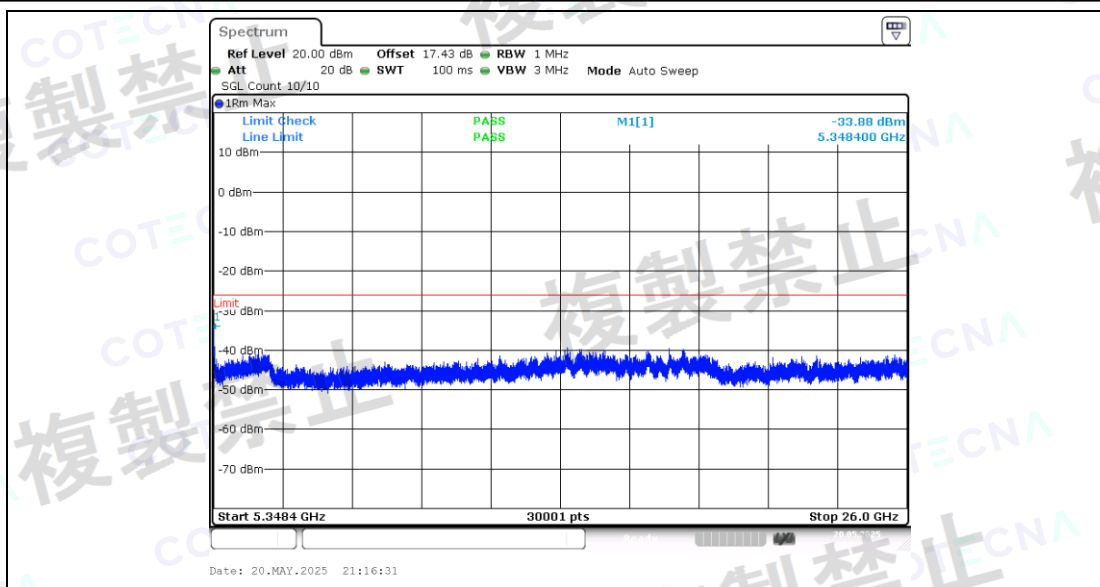

NTHV_11AC40SISO_Ant1_5310_5350~5348.4

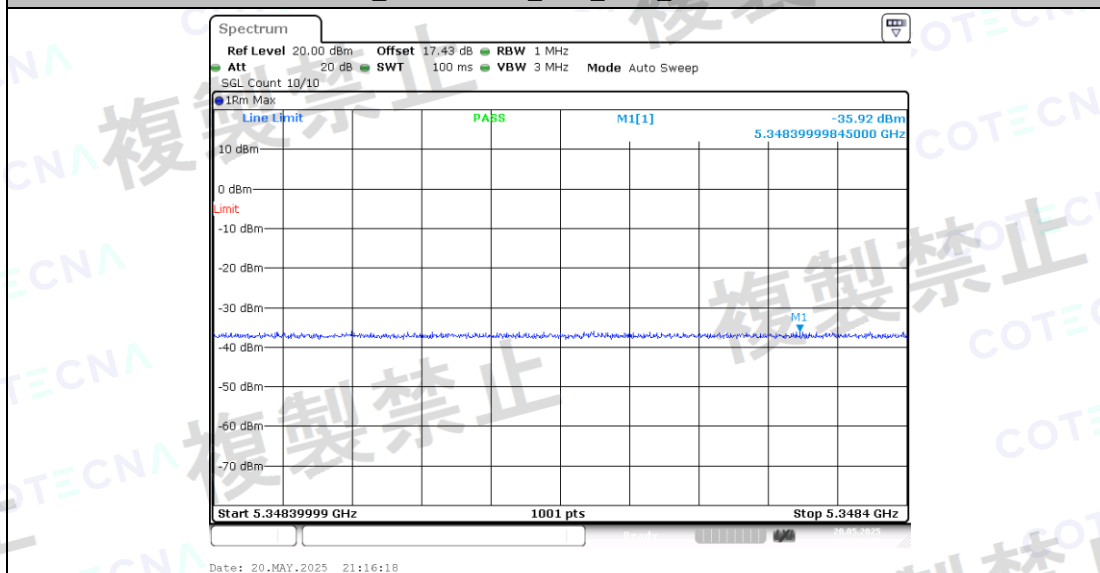



NTHV_11AC40SISO_Ant1_5510_30~5460

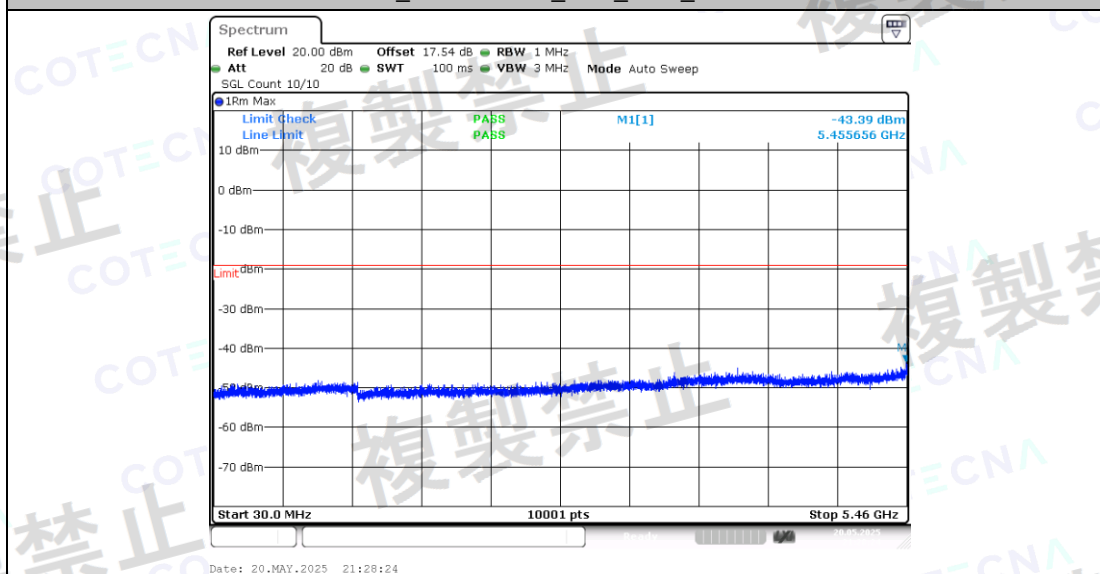

NTHV_11AC40SISO_Ant1_5510_5460~5470




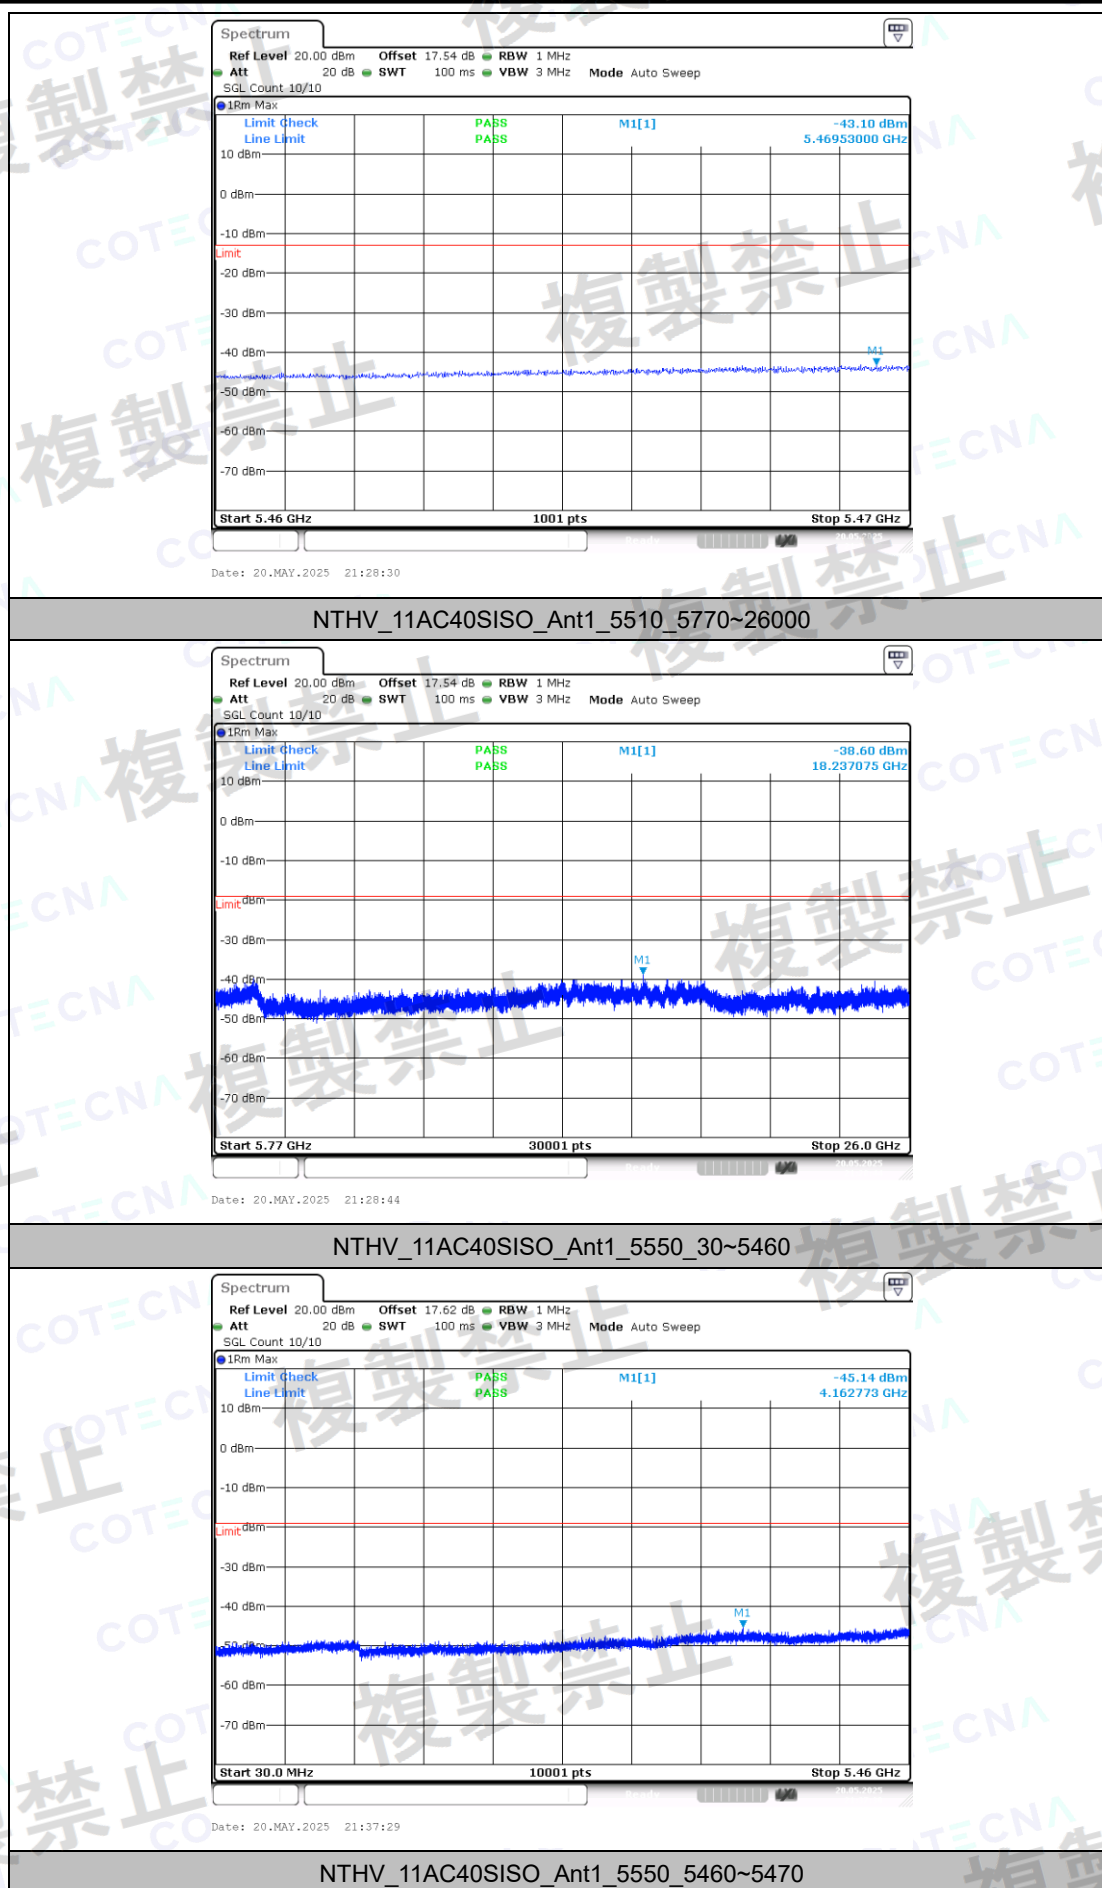

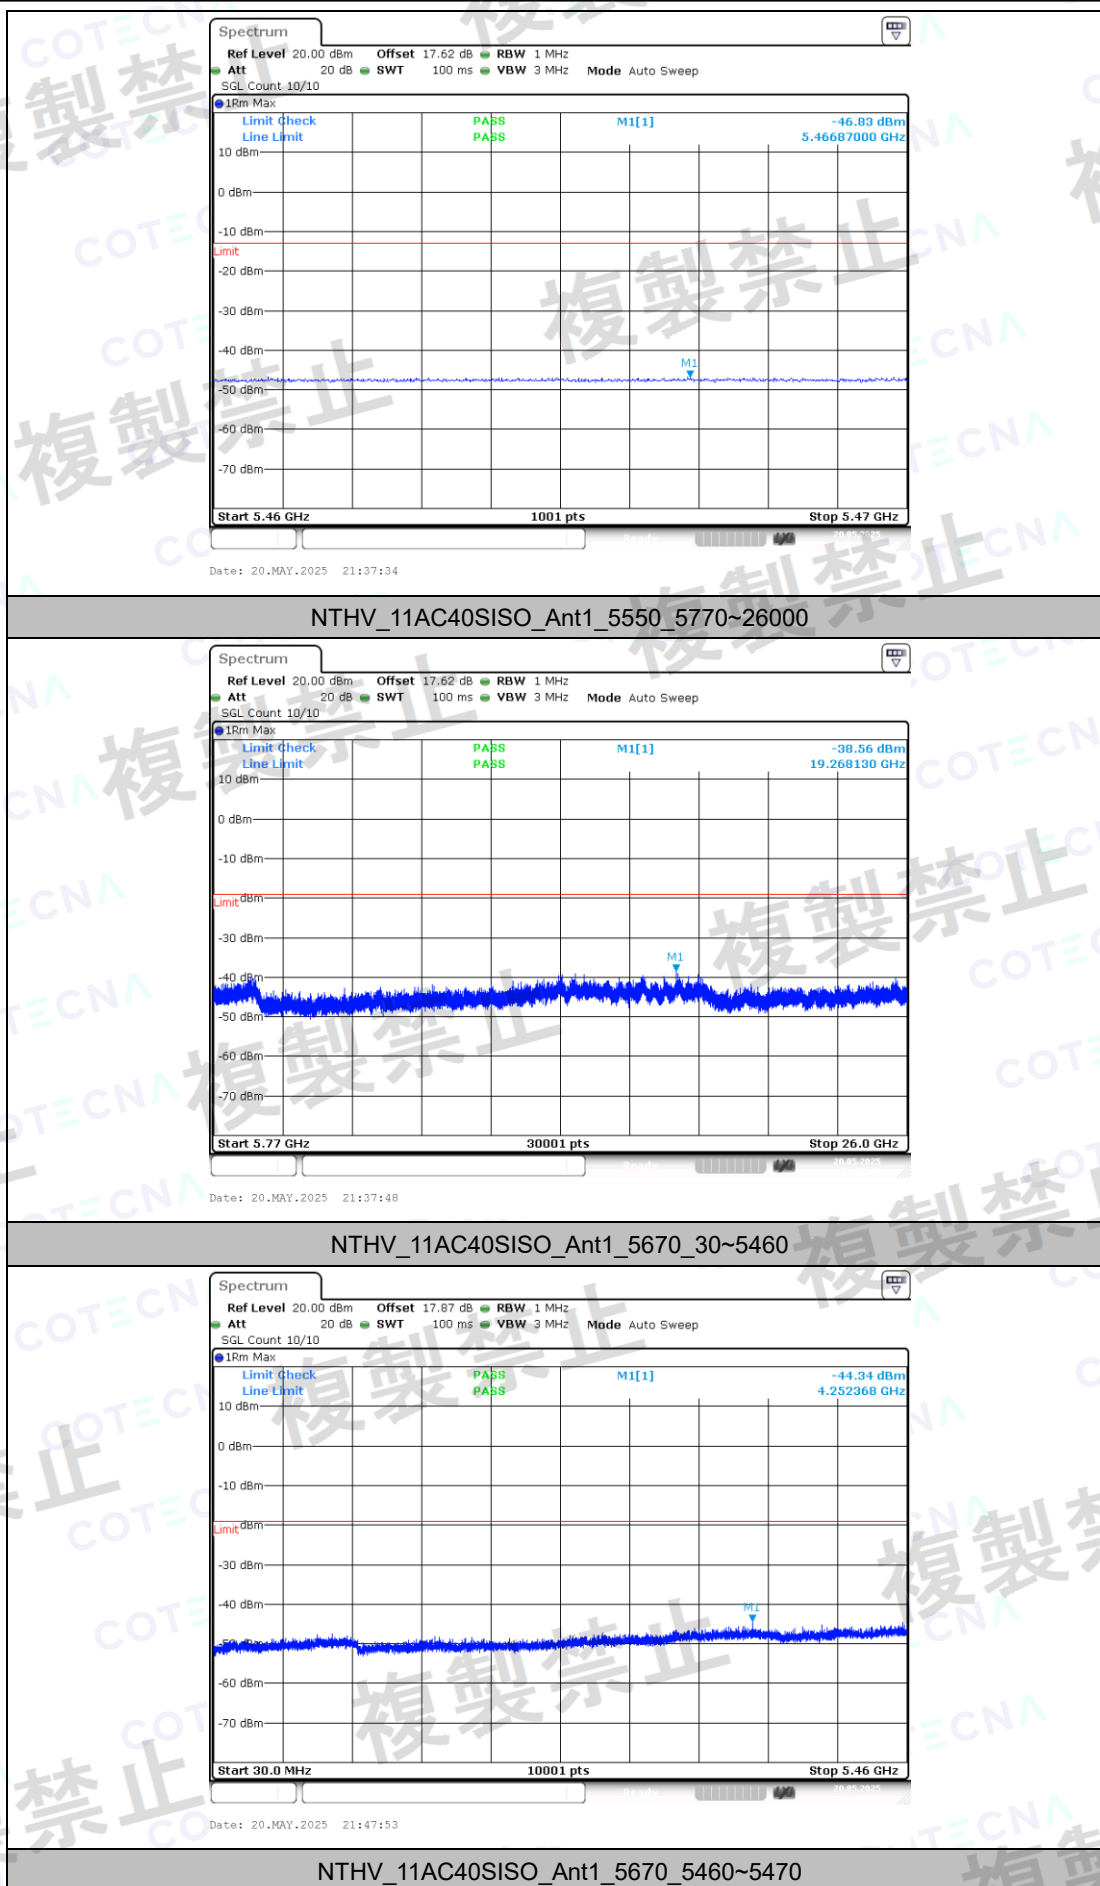




NTHV_11AC40SISO_Ant1_5670_5770~26000

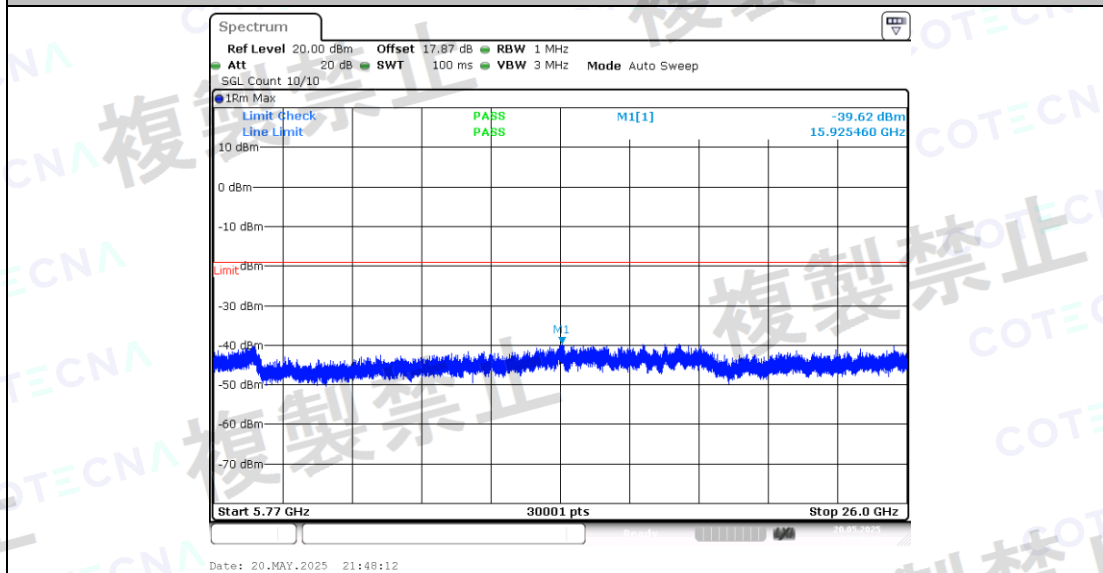



NTHV_11AC40SISO_Ant1_5710_30~5460

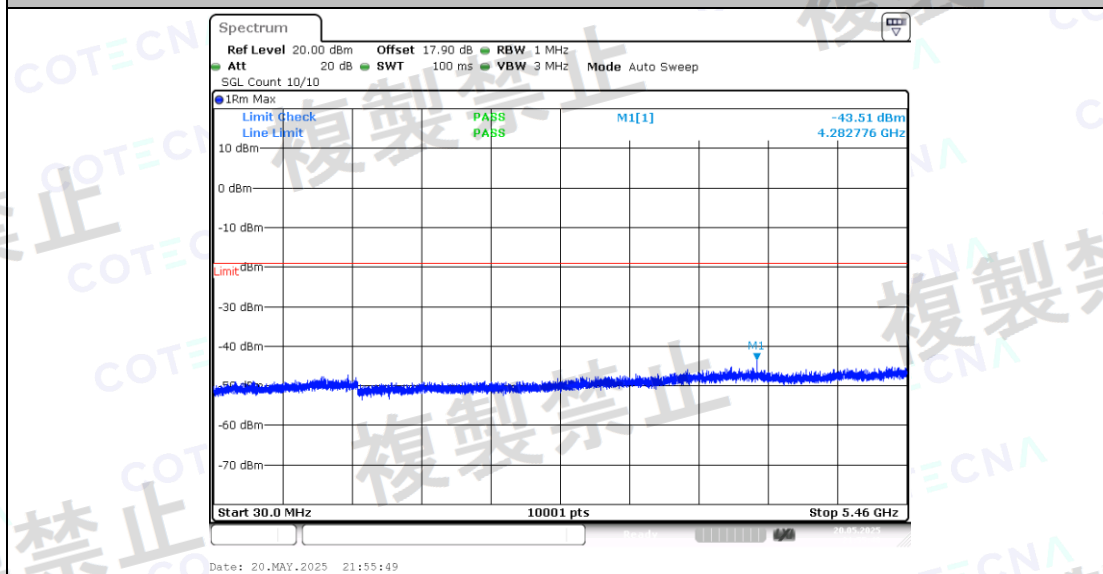


NTHV_11AC40SISO_Ant1_5710_5460~5470



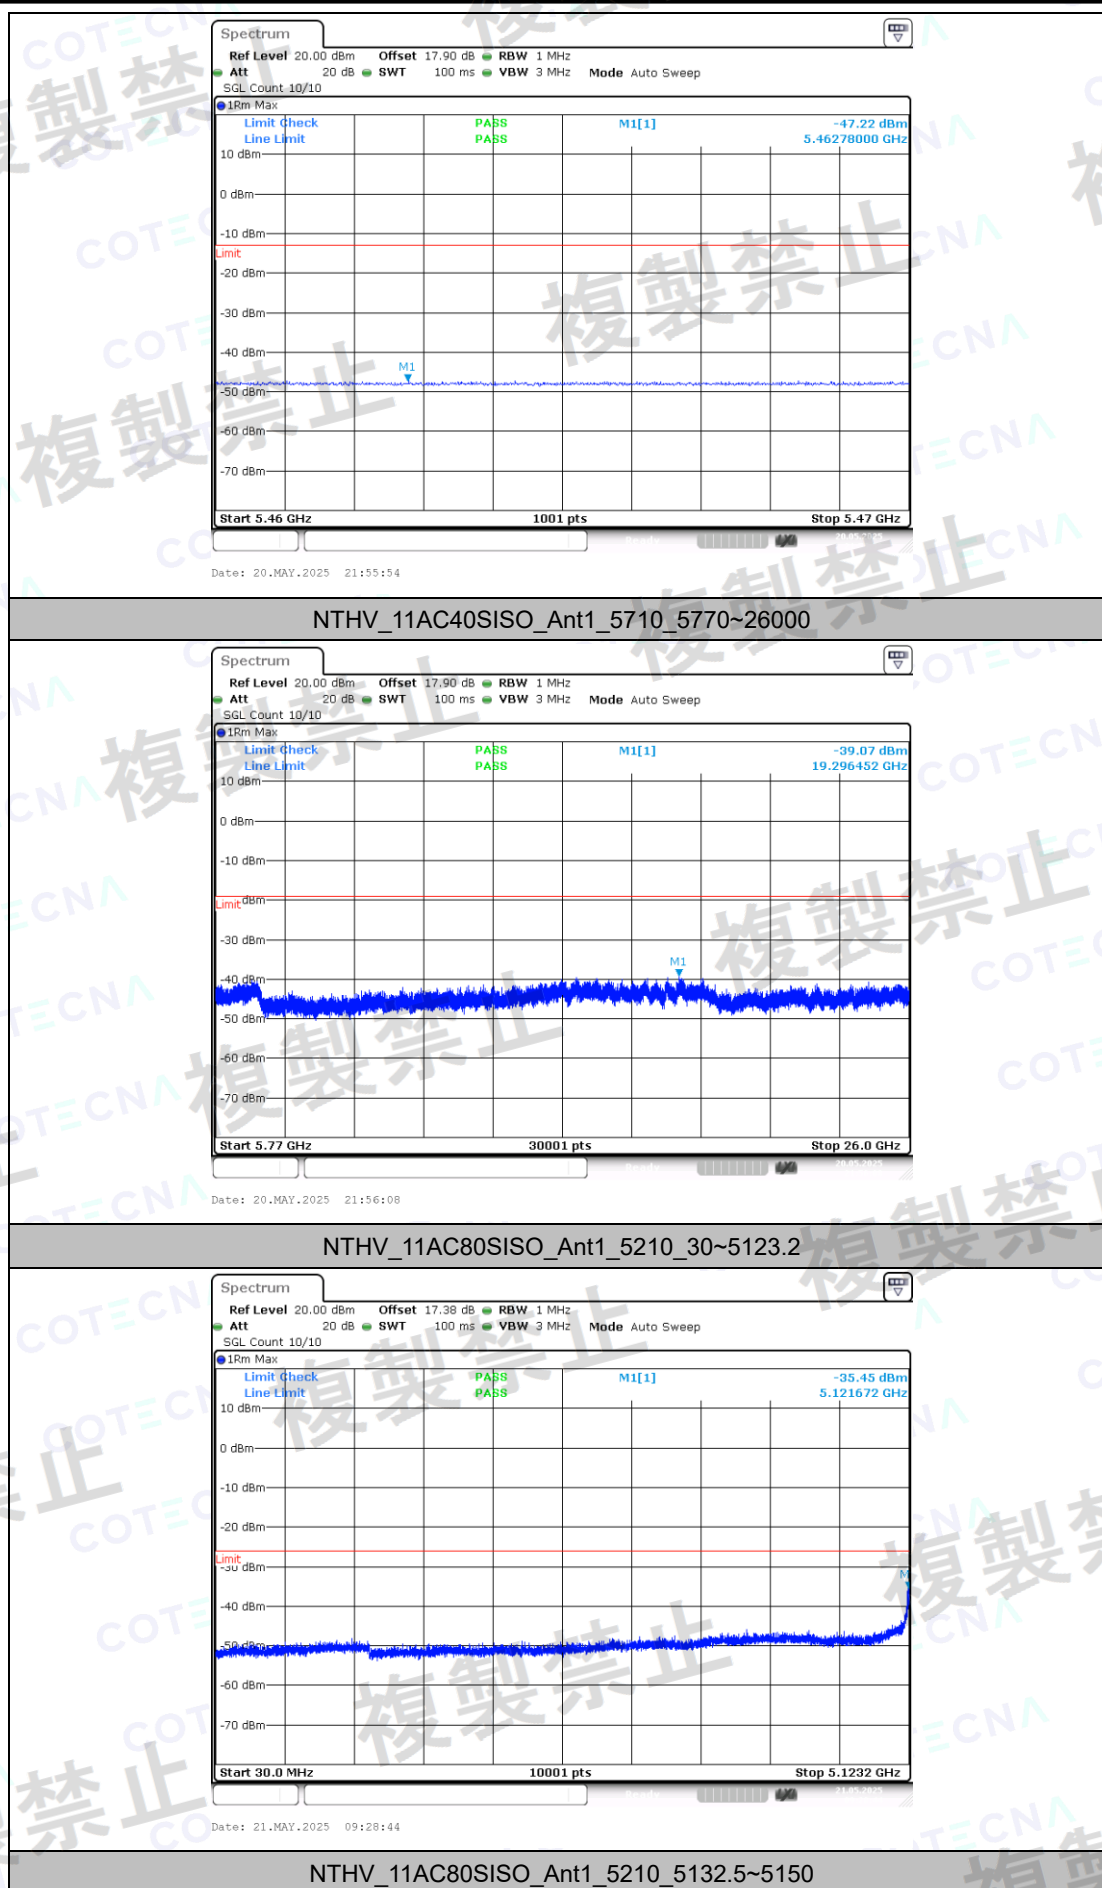


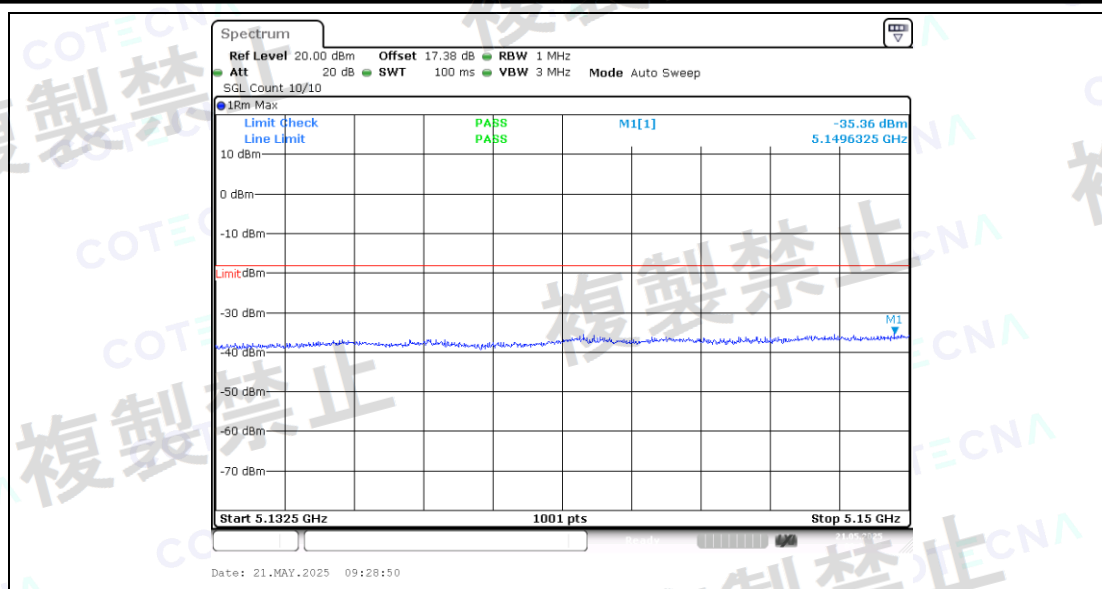

NTHV_11AC80SISO_Ant1_5210_5250~5251

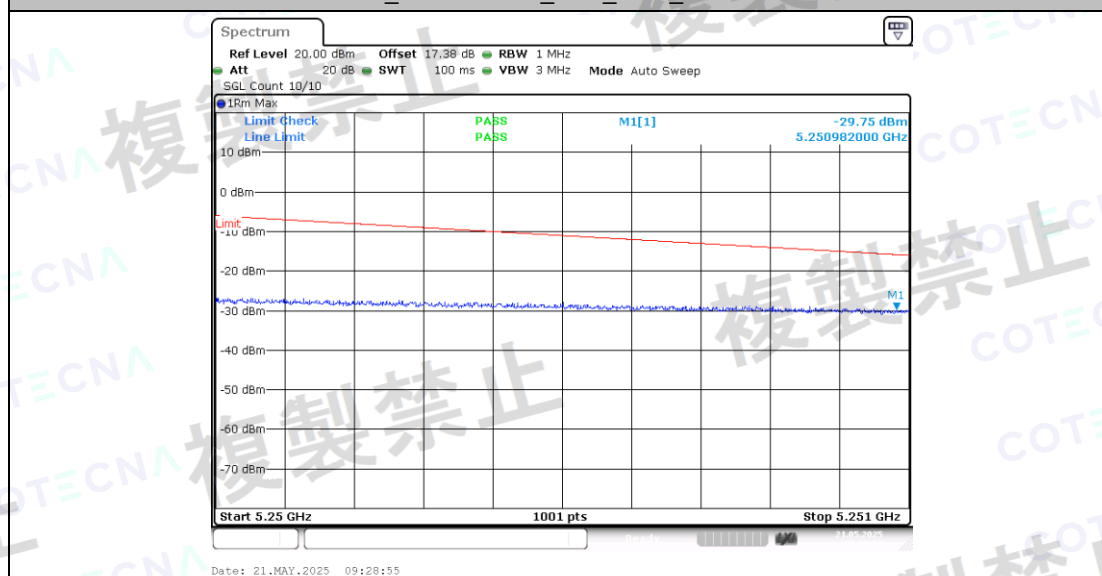


NTHV_11AC80SISO_Ant1_5210_5251~5290

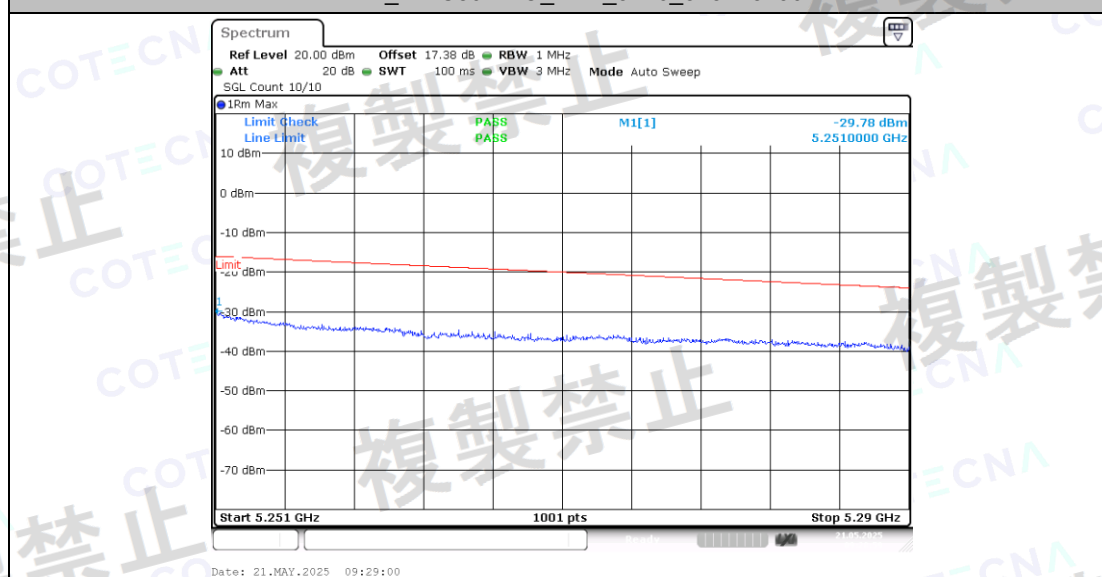

NTHV_11AC80SISO_Ant1_5210_5290~5296.7






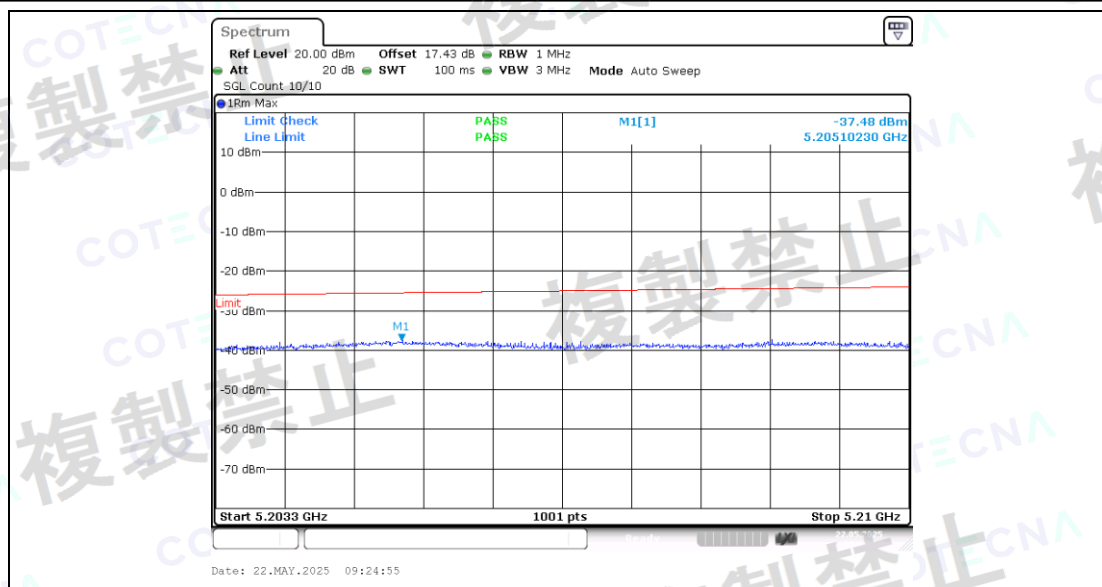

NTHV_11AC80SISO_Ant1_5290_5210~5249




NTHV_11AC80SISO_Ant1_5290_5249~5250

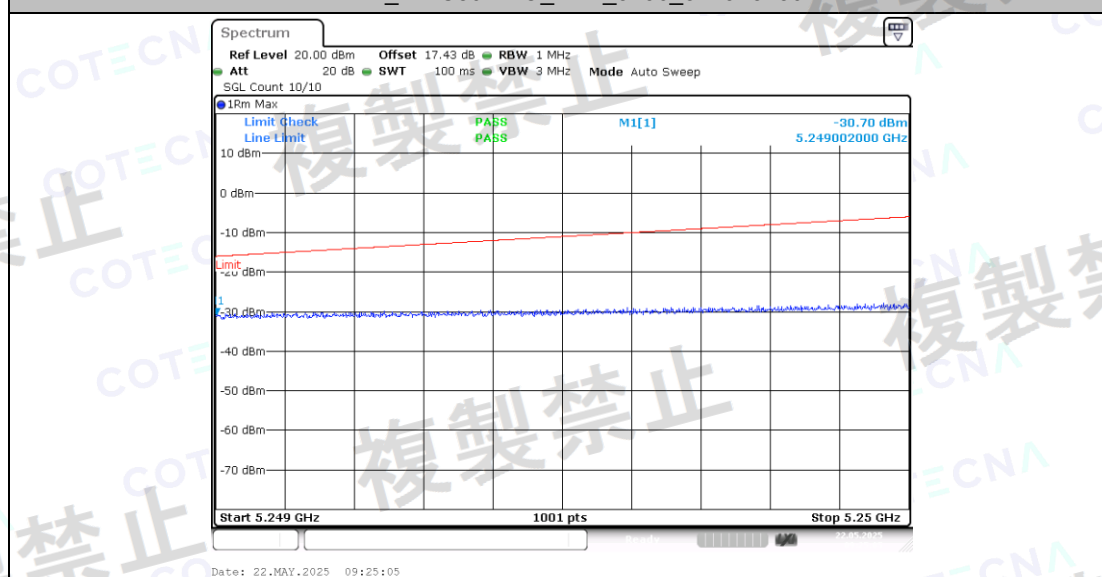


NTHV_11AC80SISO_Ant1_5290_5350~5376.8




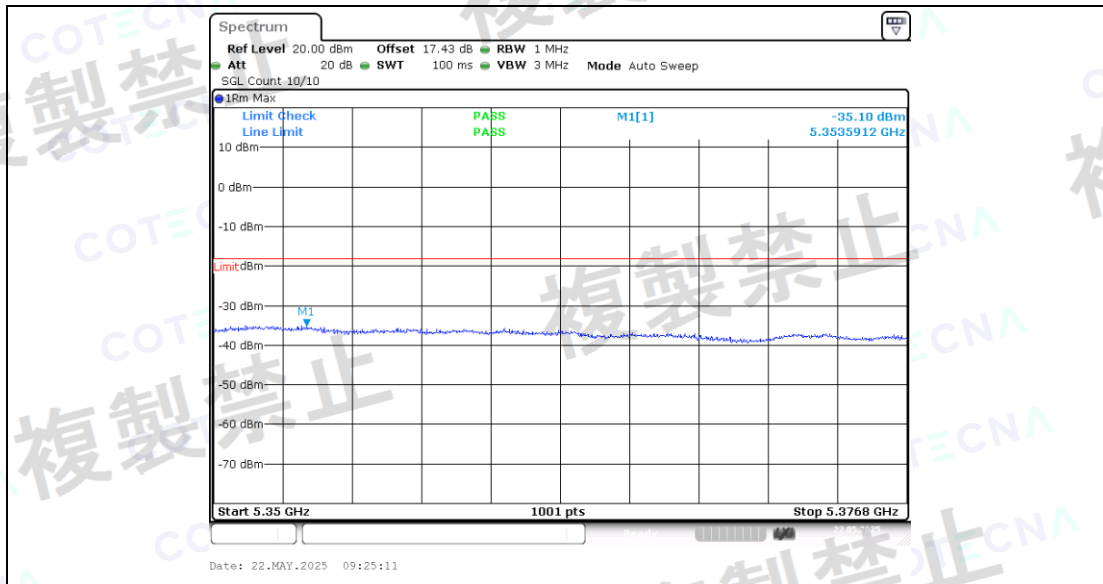

NTHV_11AC80SISO_Ant1_5290_5376.8~26000

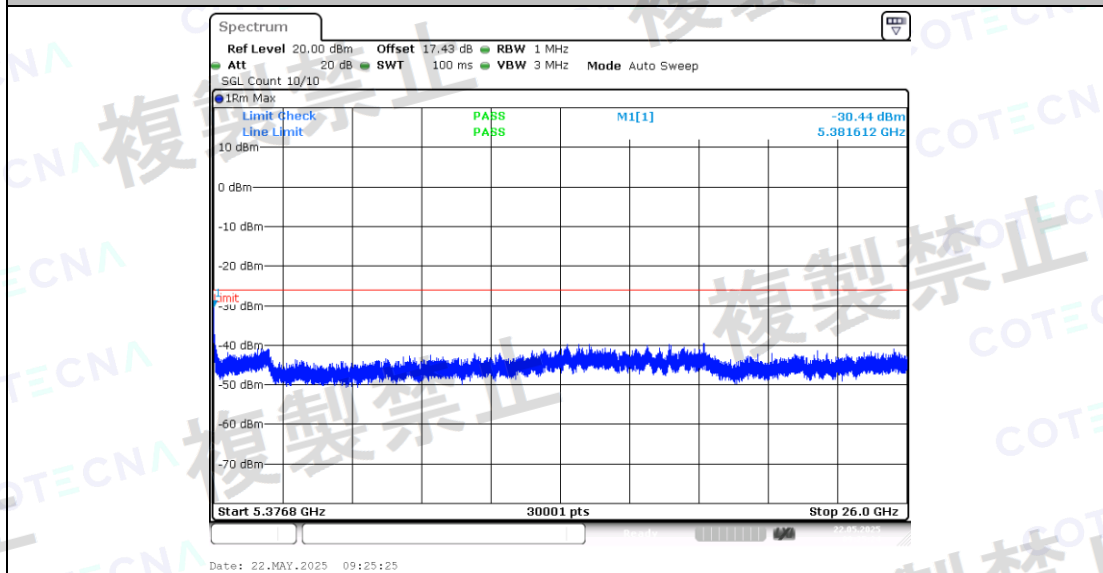

NTHV_11AC80SISO_Ant1_5530_30~5460

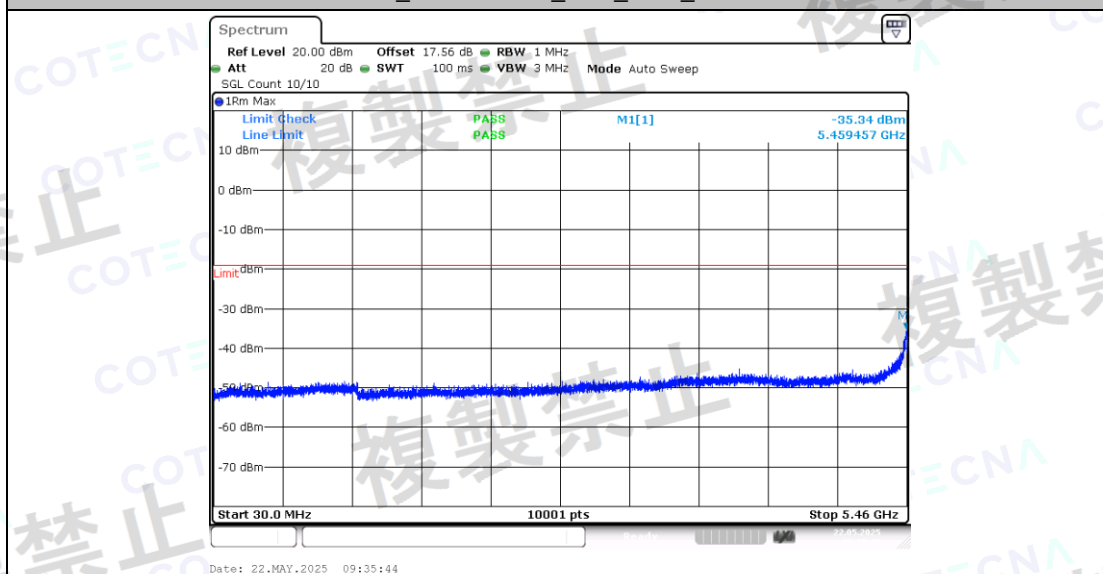



NTHV_11AC80SISO_Ant1_5530_5460~5469.5







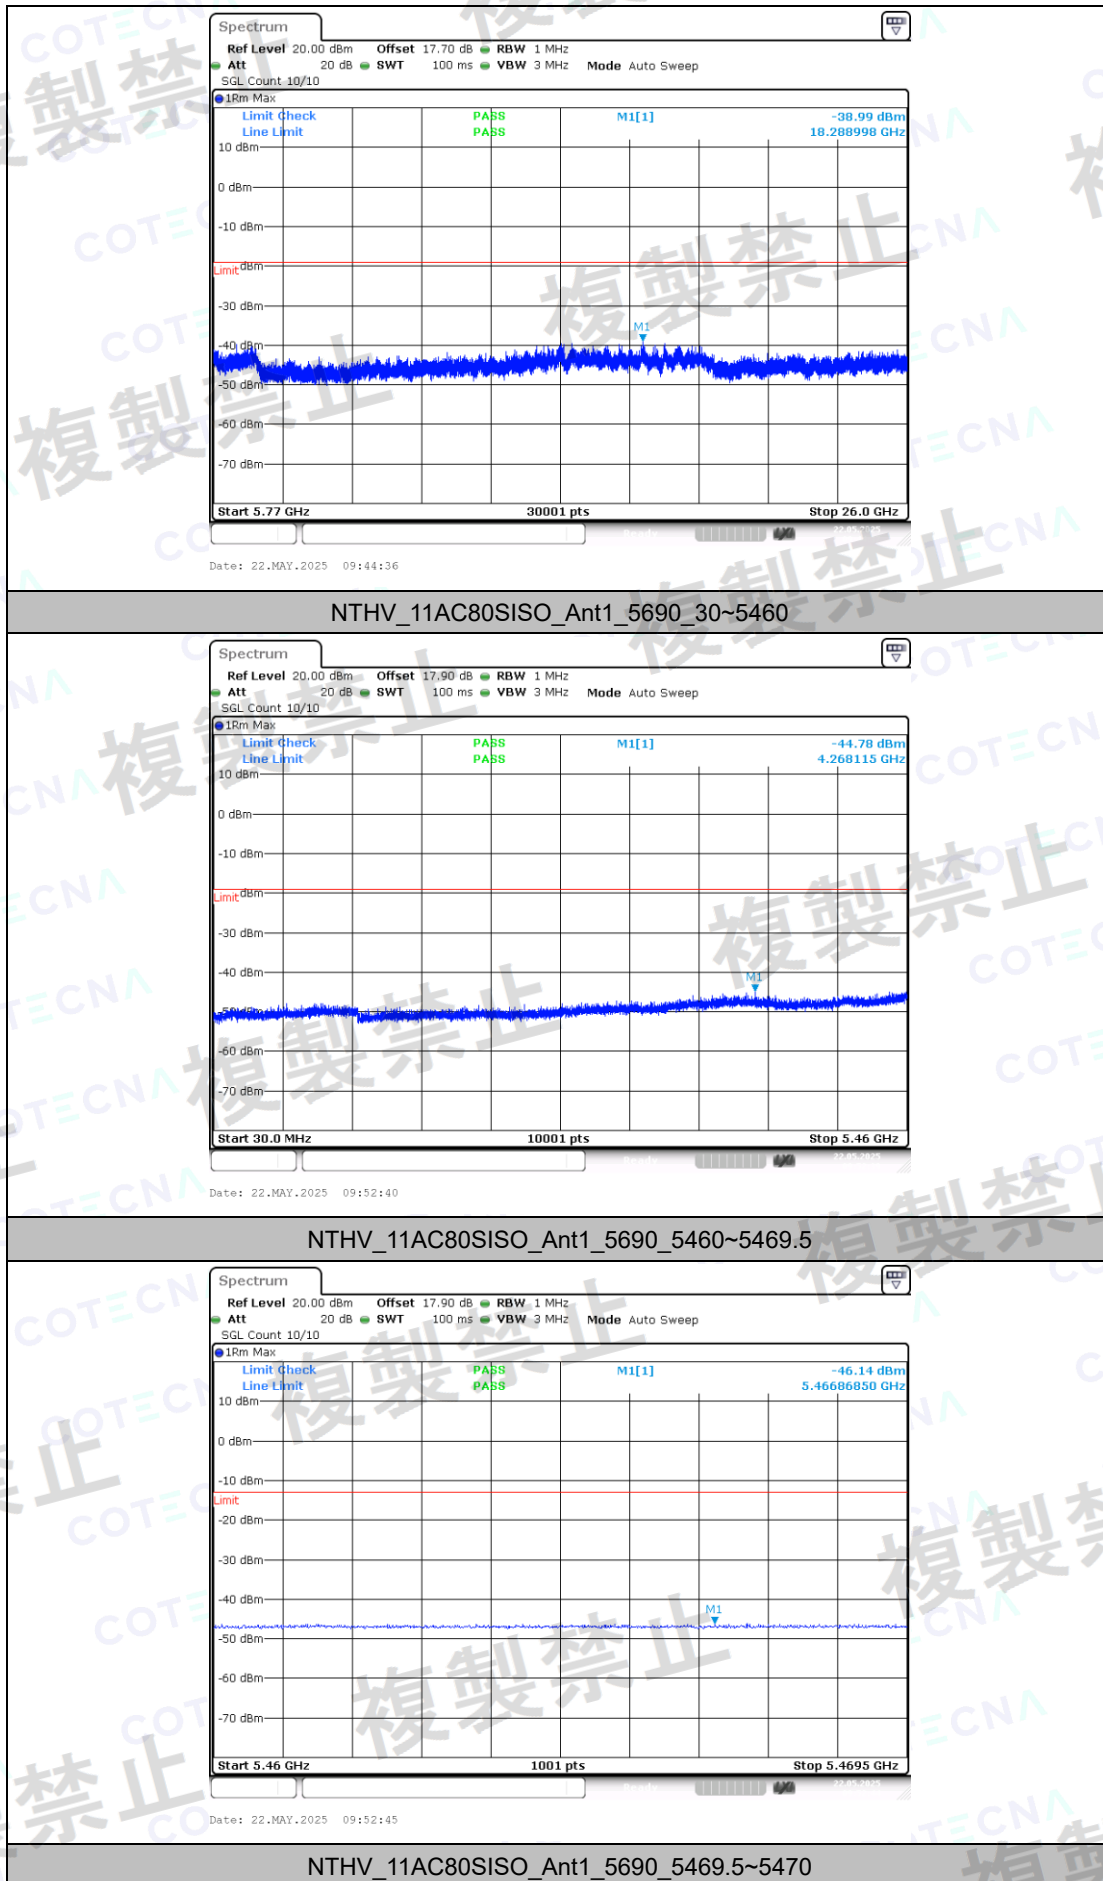

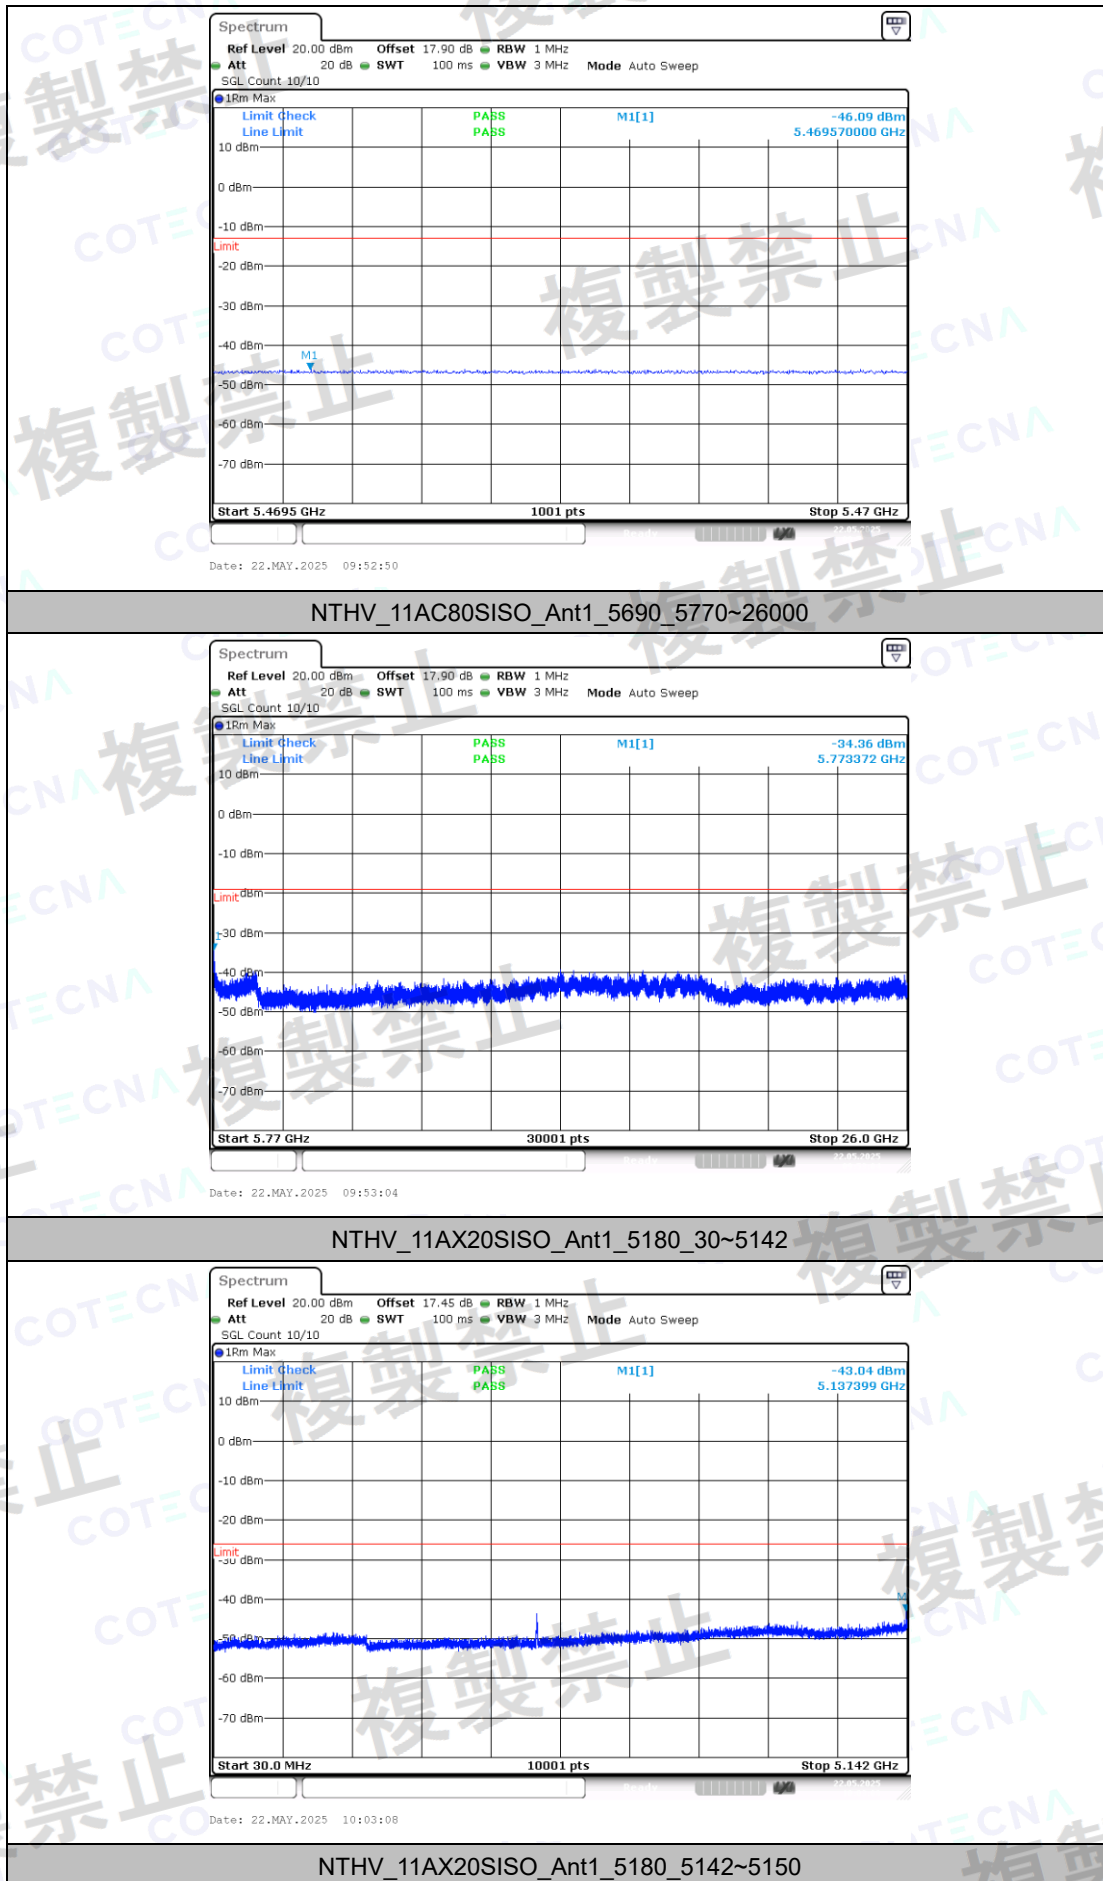












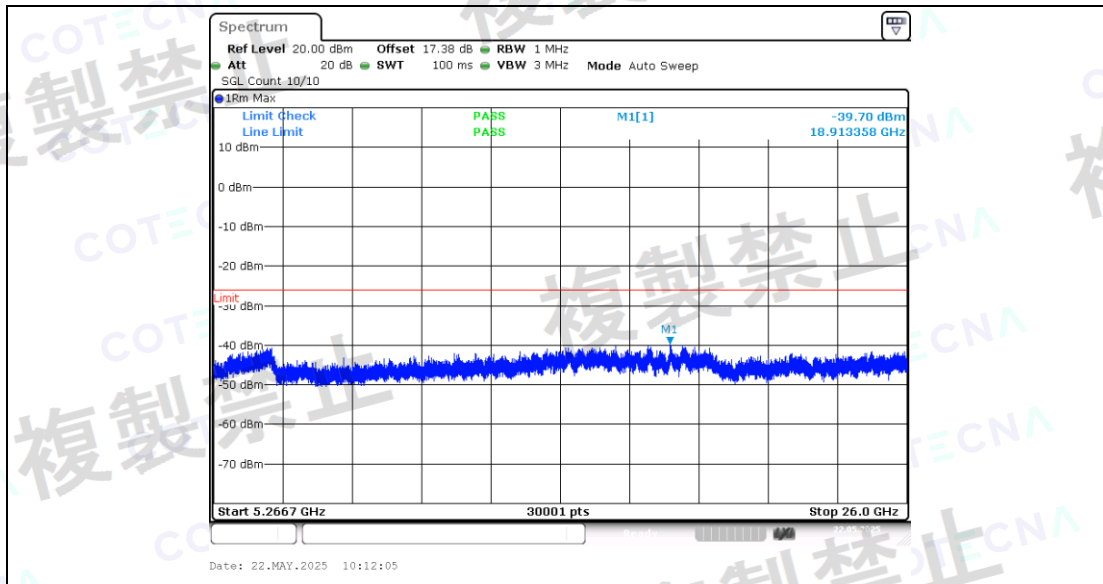

NTHV_11AX20SISO_Ant1_5240_30~5142

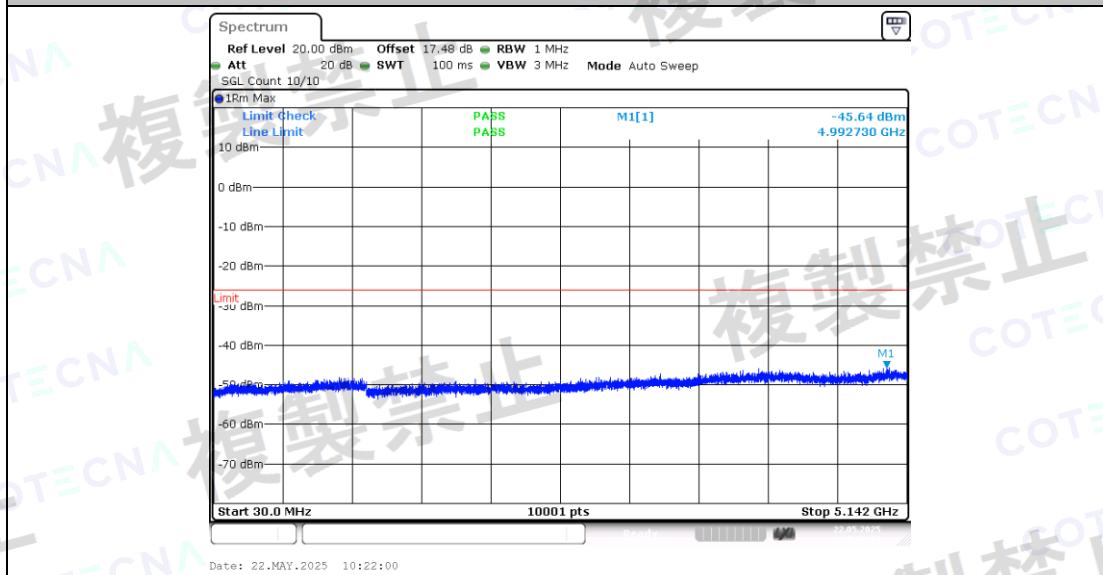


NTHV_11AX20SISO_Ant1_5240_5142~5150

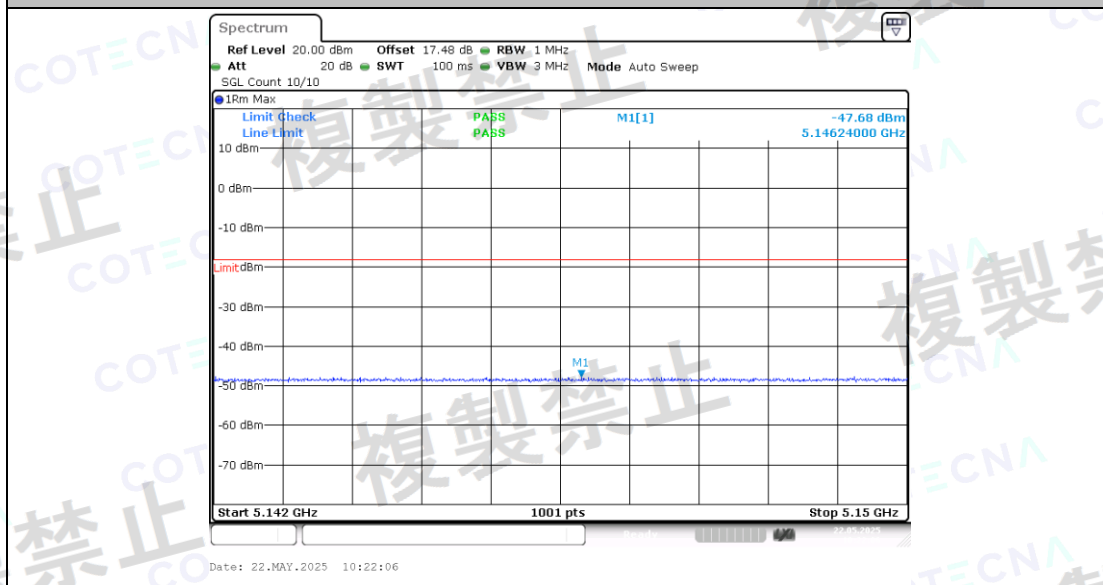


NTHV_11AX20SISO_Ant1_5240_5250~5250.2




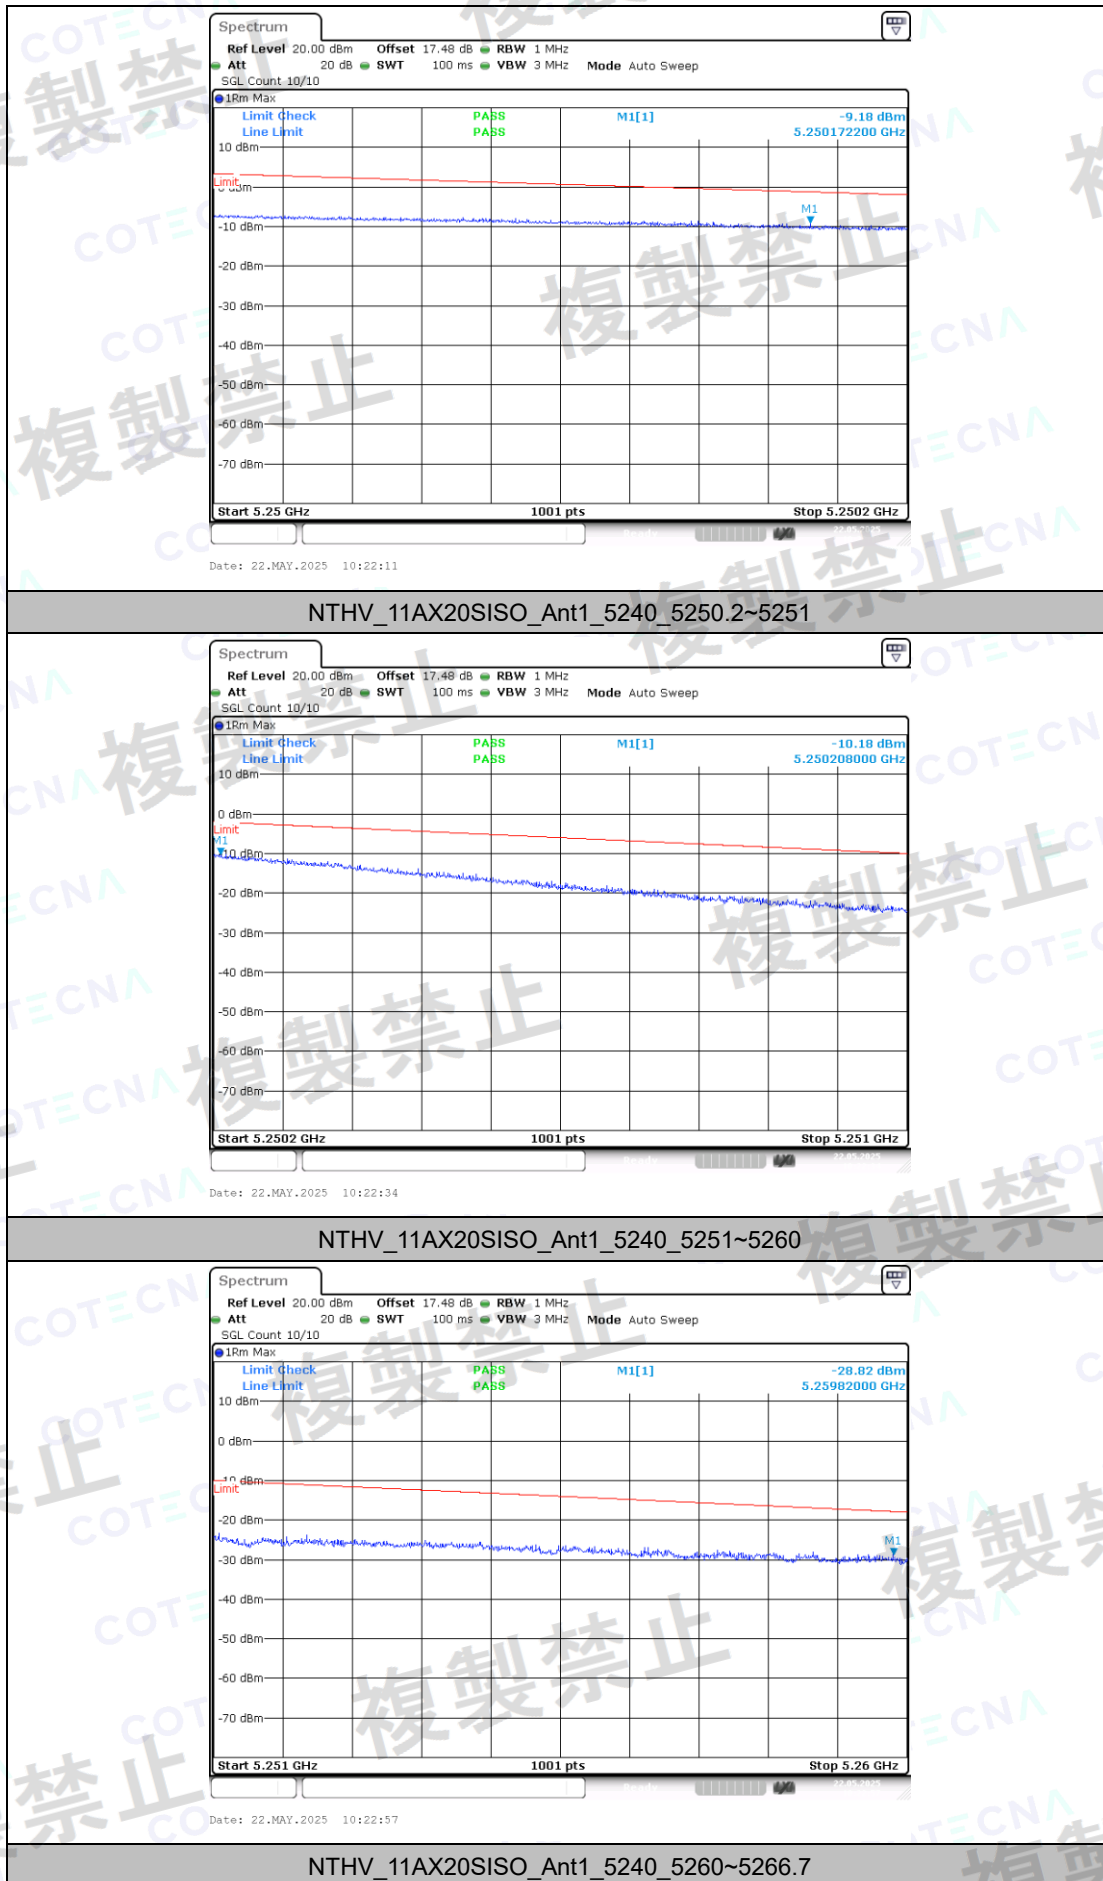




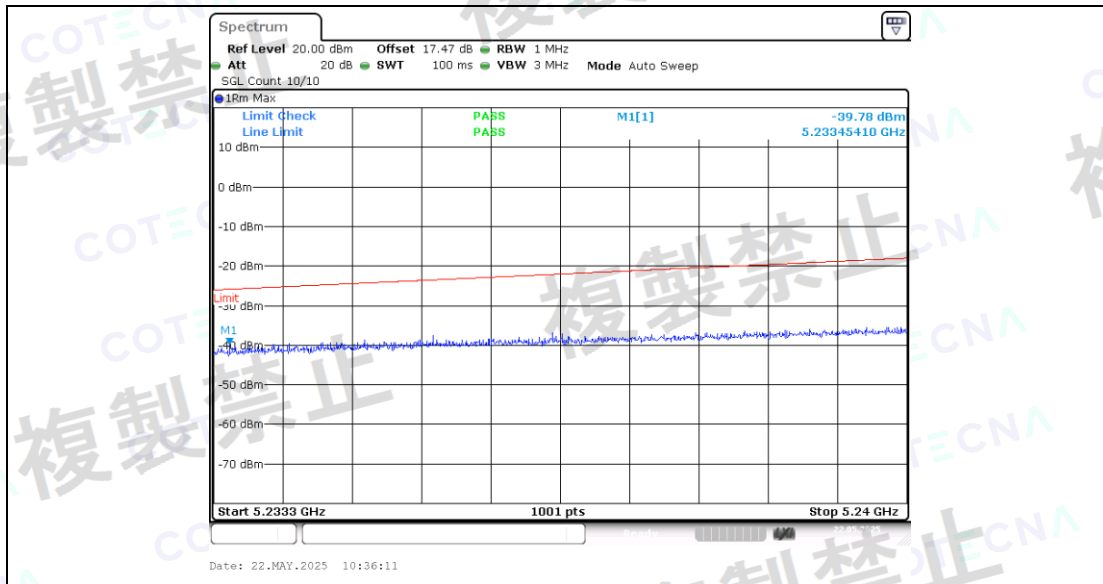

NTHV_11AX20SISO_Ant1_5260_5240~5249

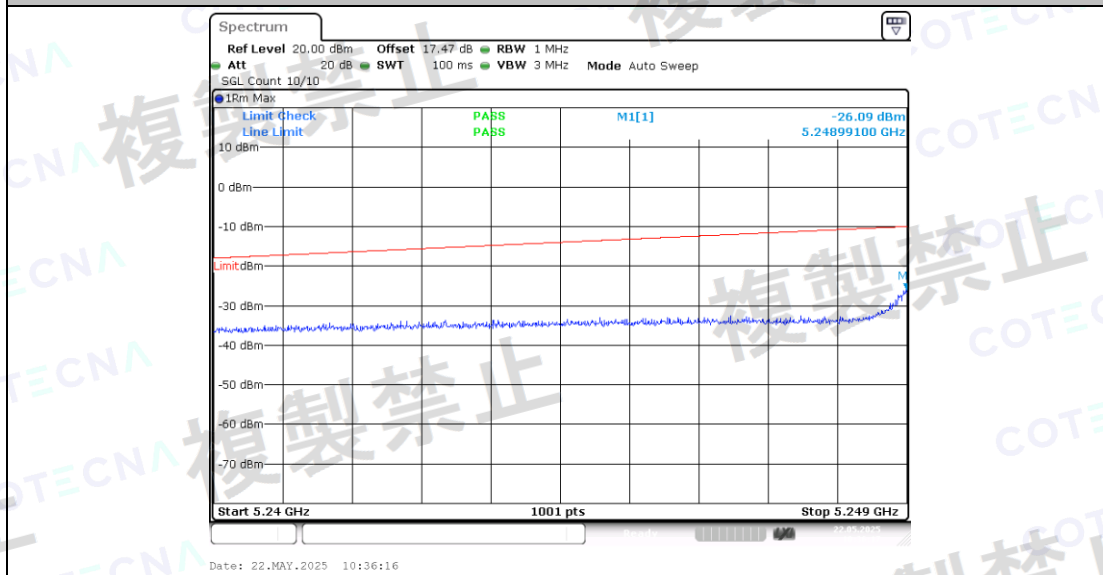


NTHV_11AX20SISO_Ant1_5260_5249~5249.8

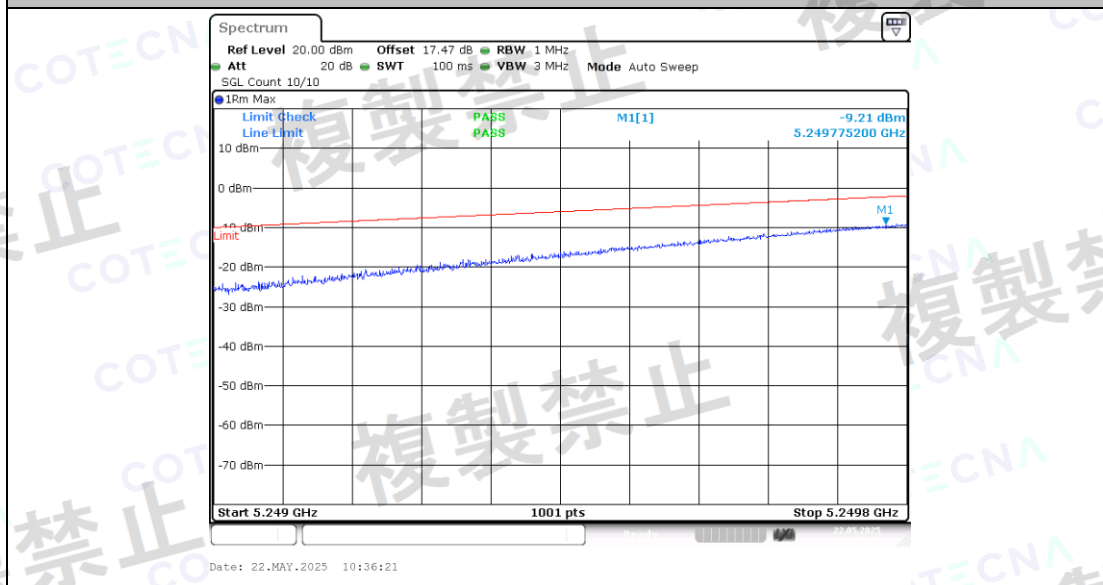


NTHV_11AX20SISO_Ant1_5260_5249.8~5250






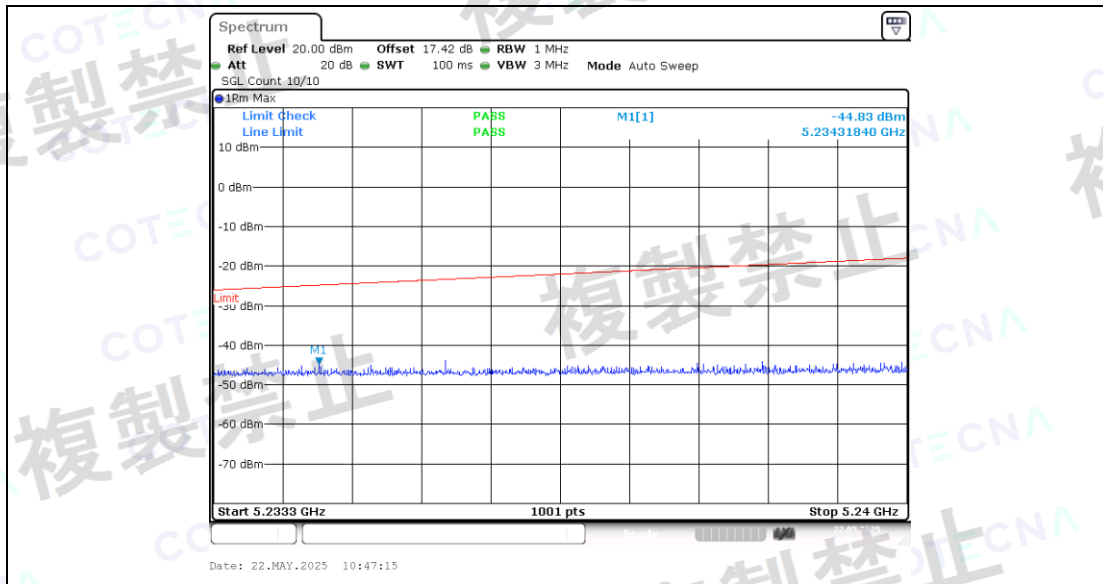

NTHV_11AX20SISO_Ant1_5280_5240~5249

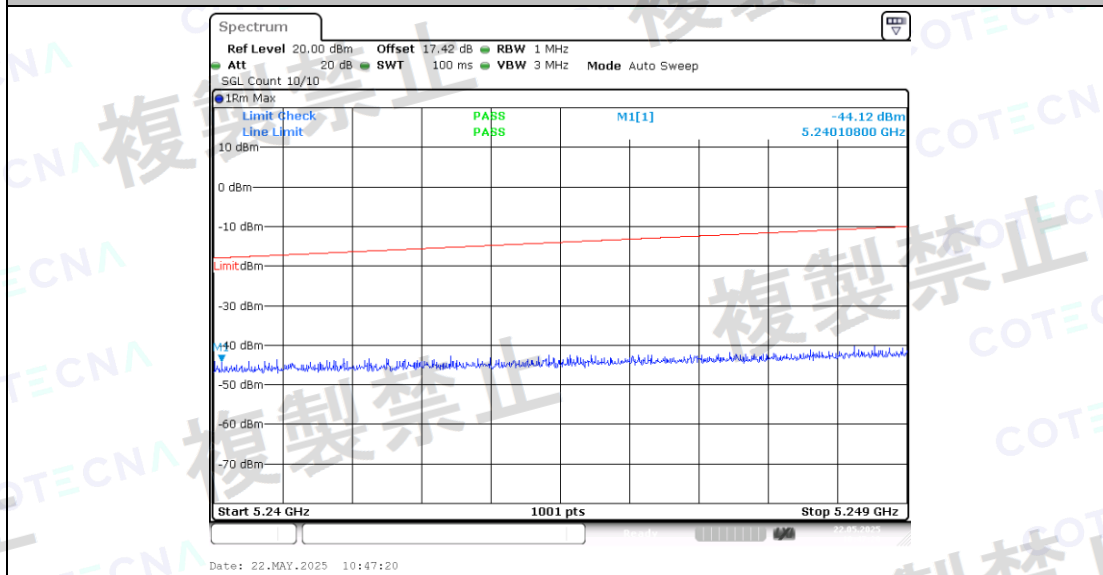


NTHV_11AX20SISO_Ant1_5280_5249~5249.8

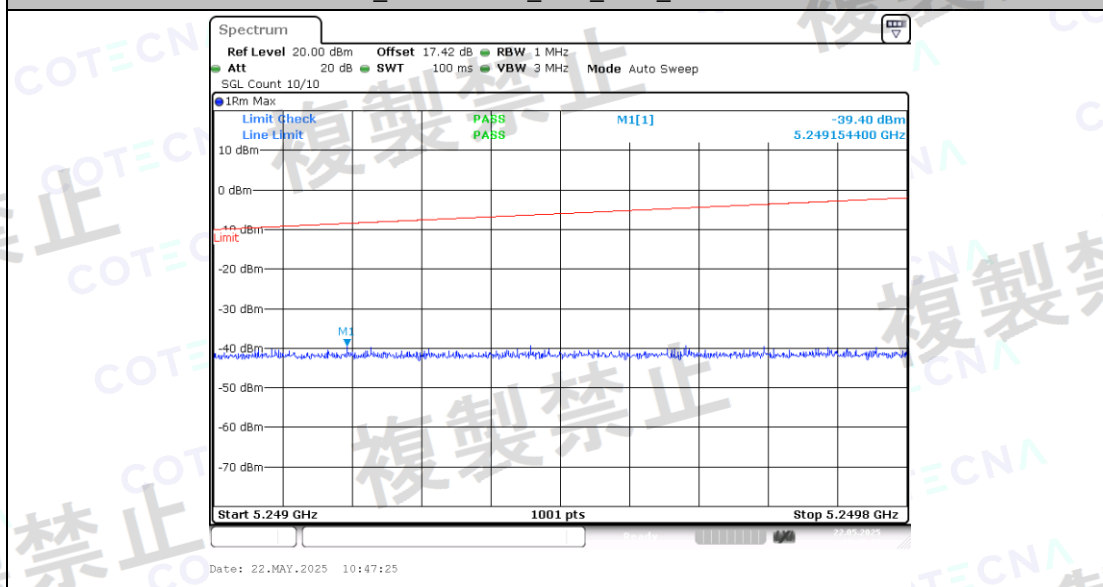


NTHV_11AX20SISO_Ant1_5280_5249.8~5250




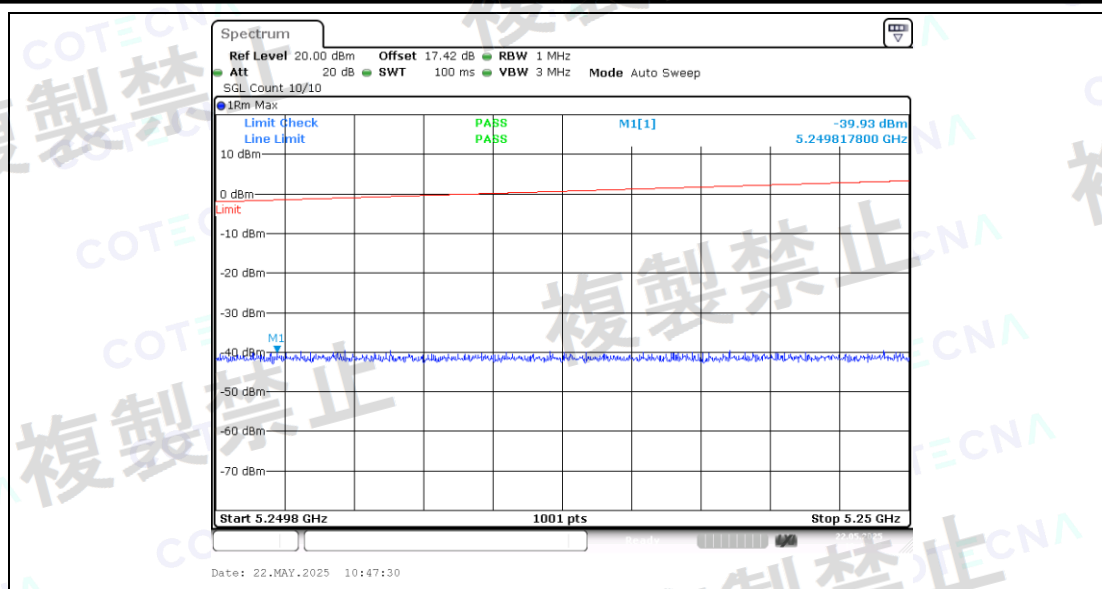

NTHV_11AX20SISO_Ant1_5280_5350~26000

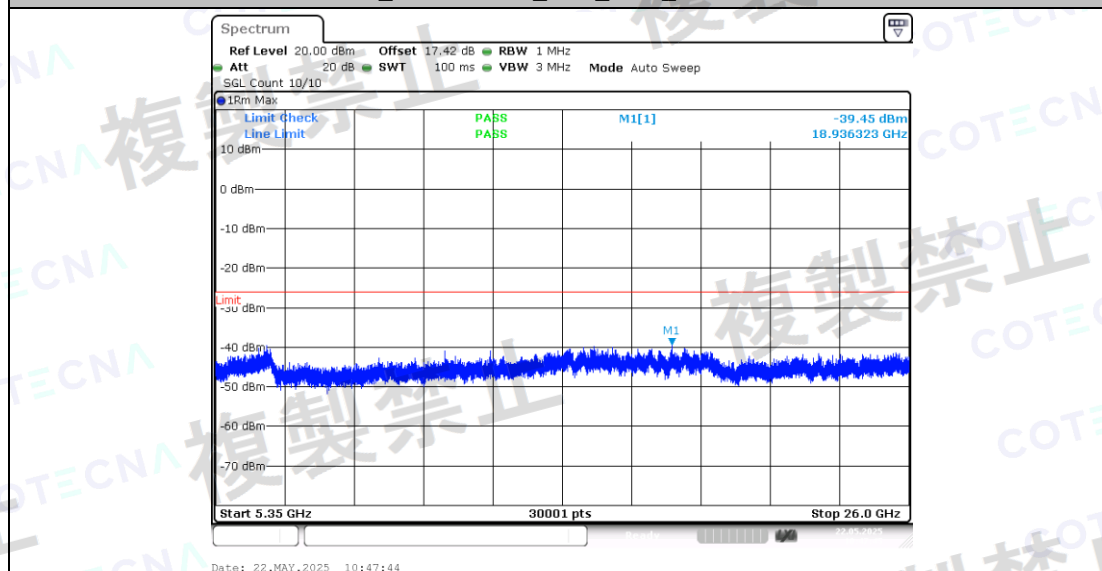


NTHV_11AX20SISO_Ant1_5300_30~5233.3

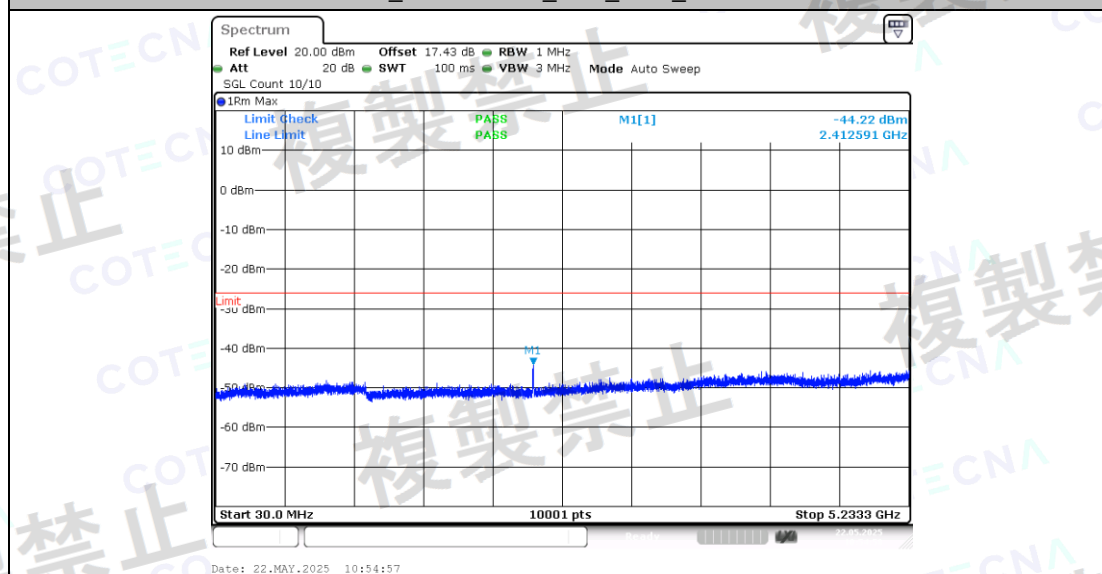


NTHV_11AX20SISO_Ant1_5300_5233.3~5240




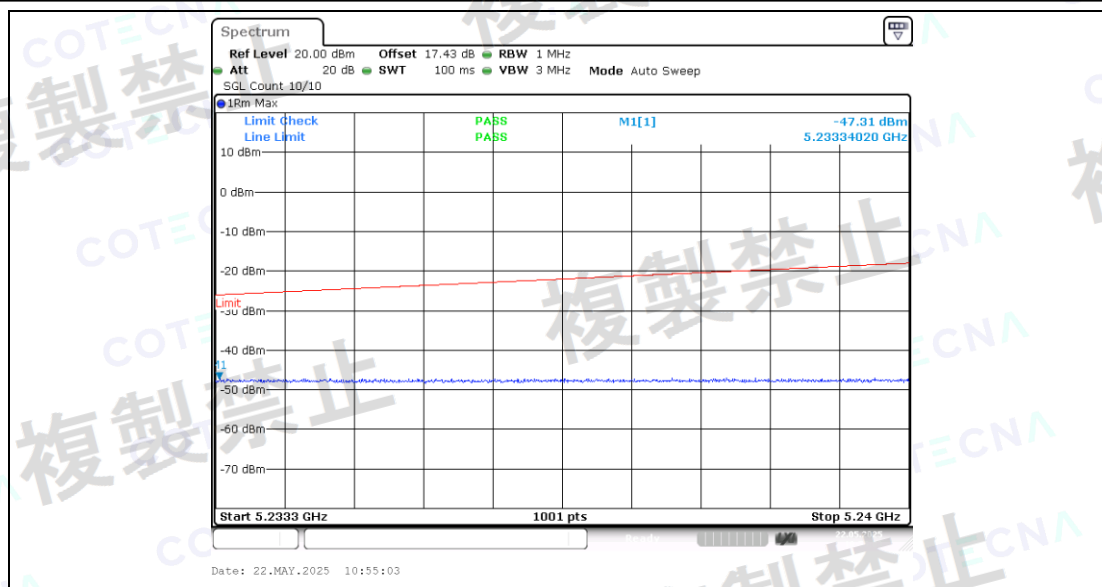

NTHV_11AX20SISO_Ant1_5300_5240~5249

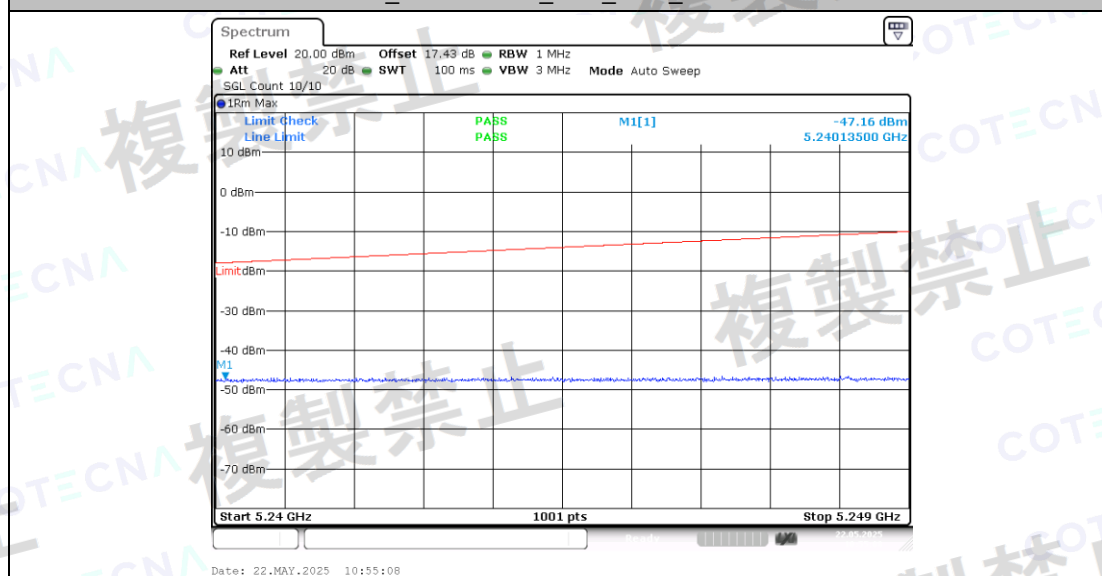


NTHV_11AX20SISO_Ant1_5300_5249~5249.8

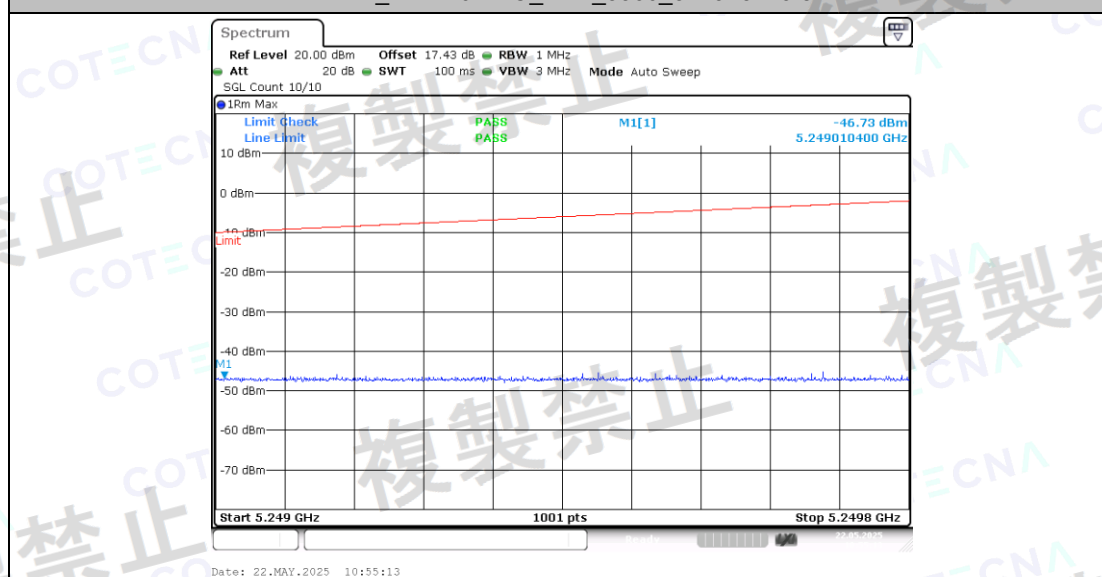


NTHV_11AX20SISO_Ant1_5300_5249.8~5250






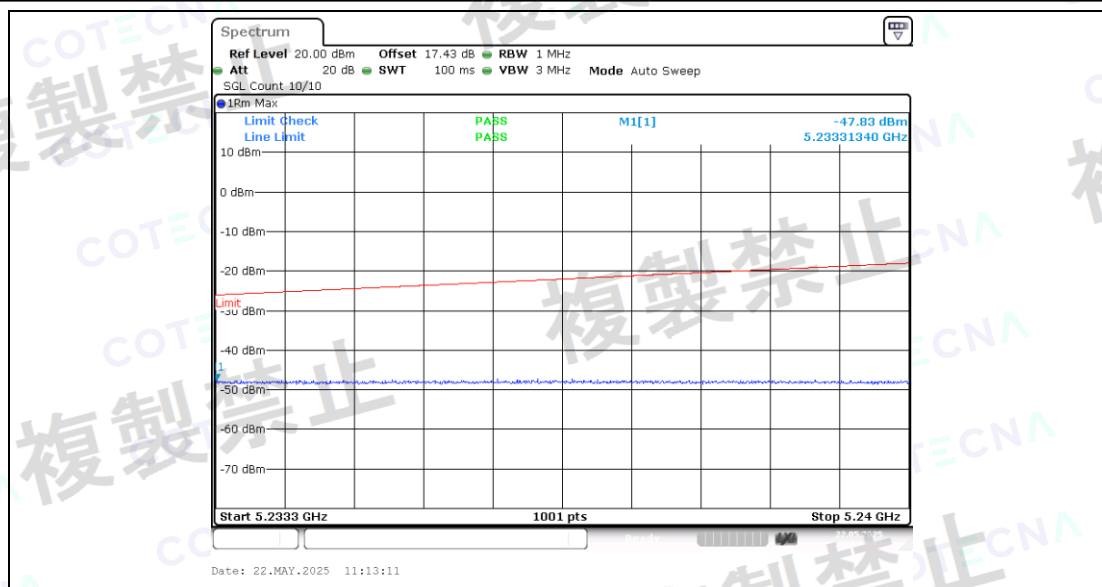

NTHV_11AX20SISO_Ant1_5320_5240~5249

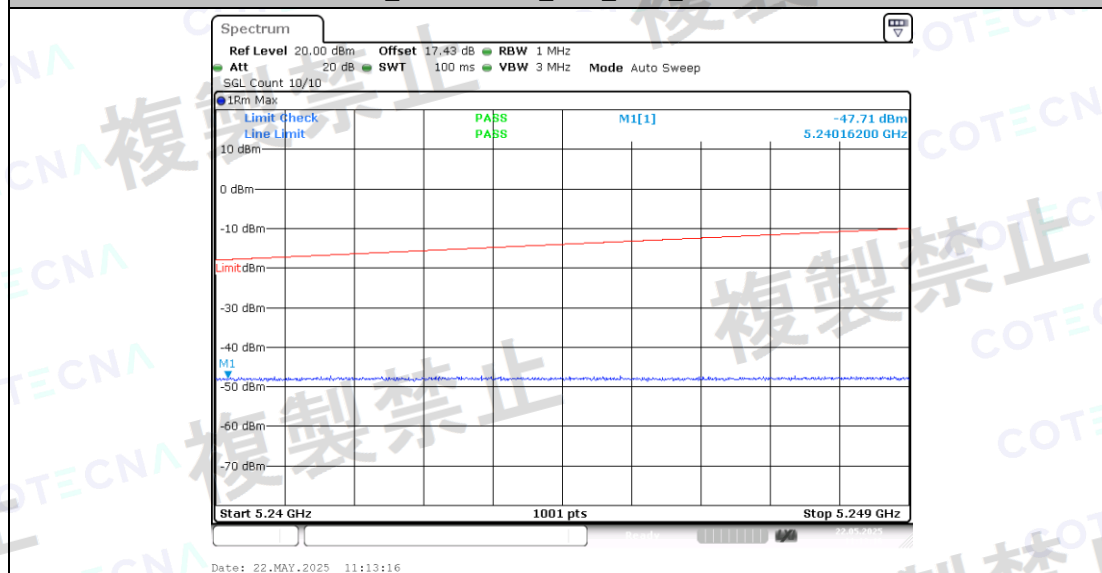

NTHV_11AX20SISO_Ant1_5320_5249~5249.8

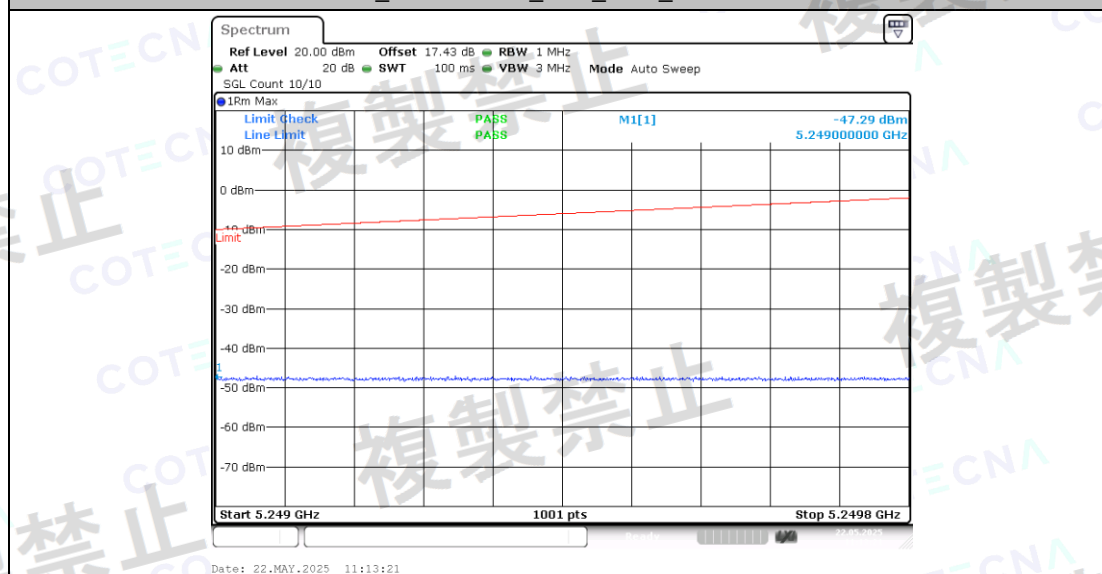

NTHV_11AX20SISO_Ant1_5320_5249.8~5250












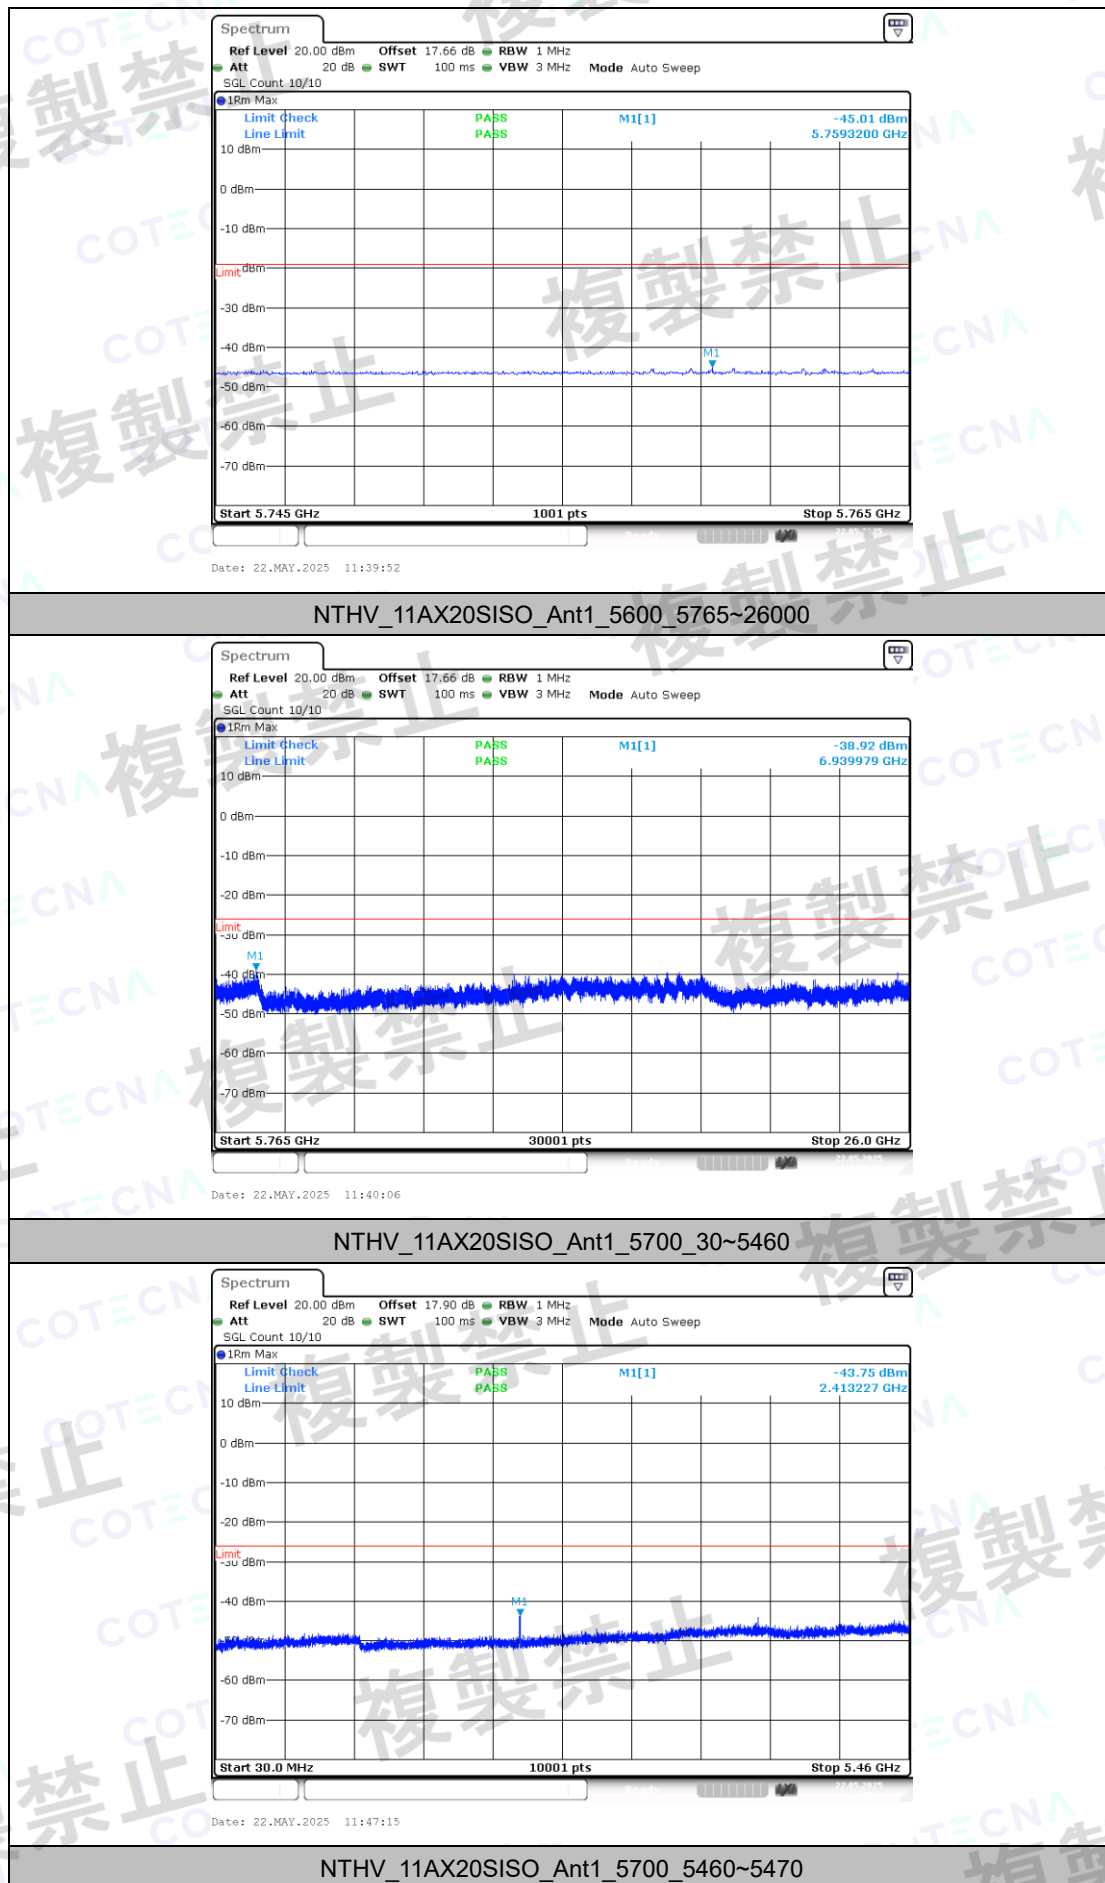












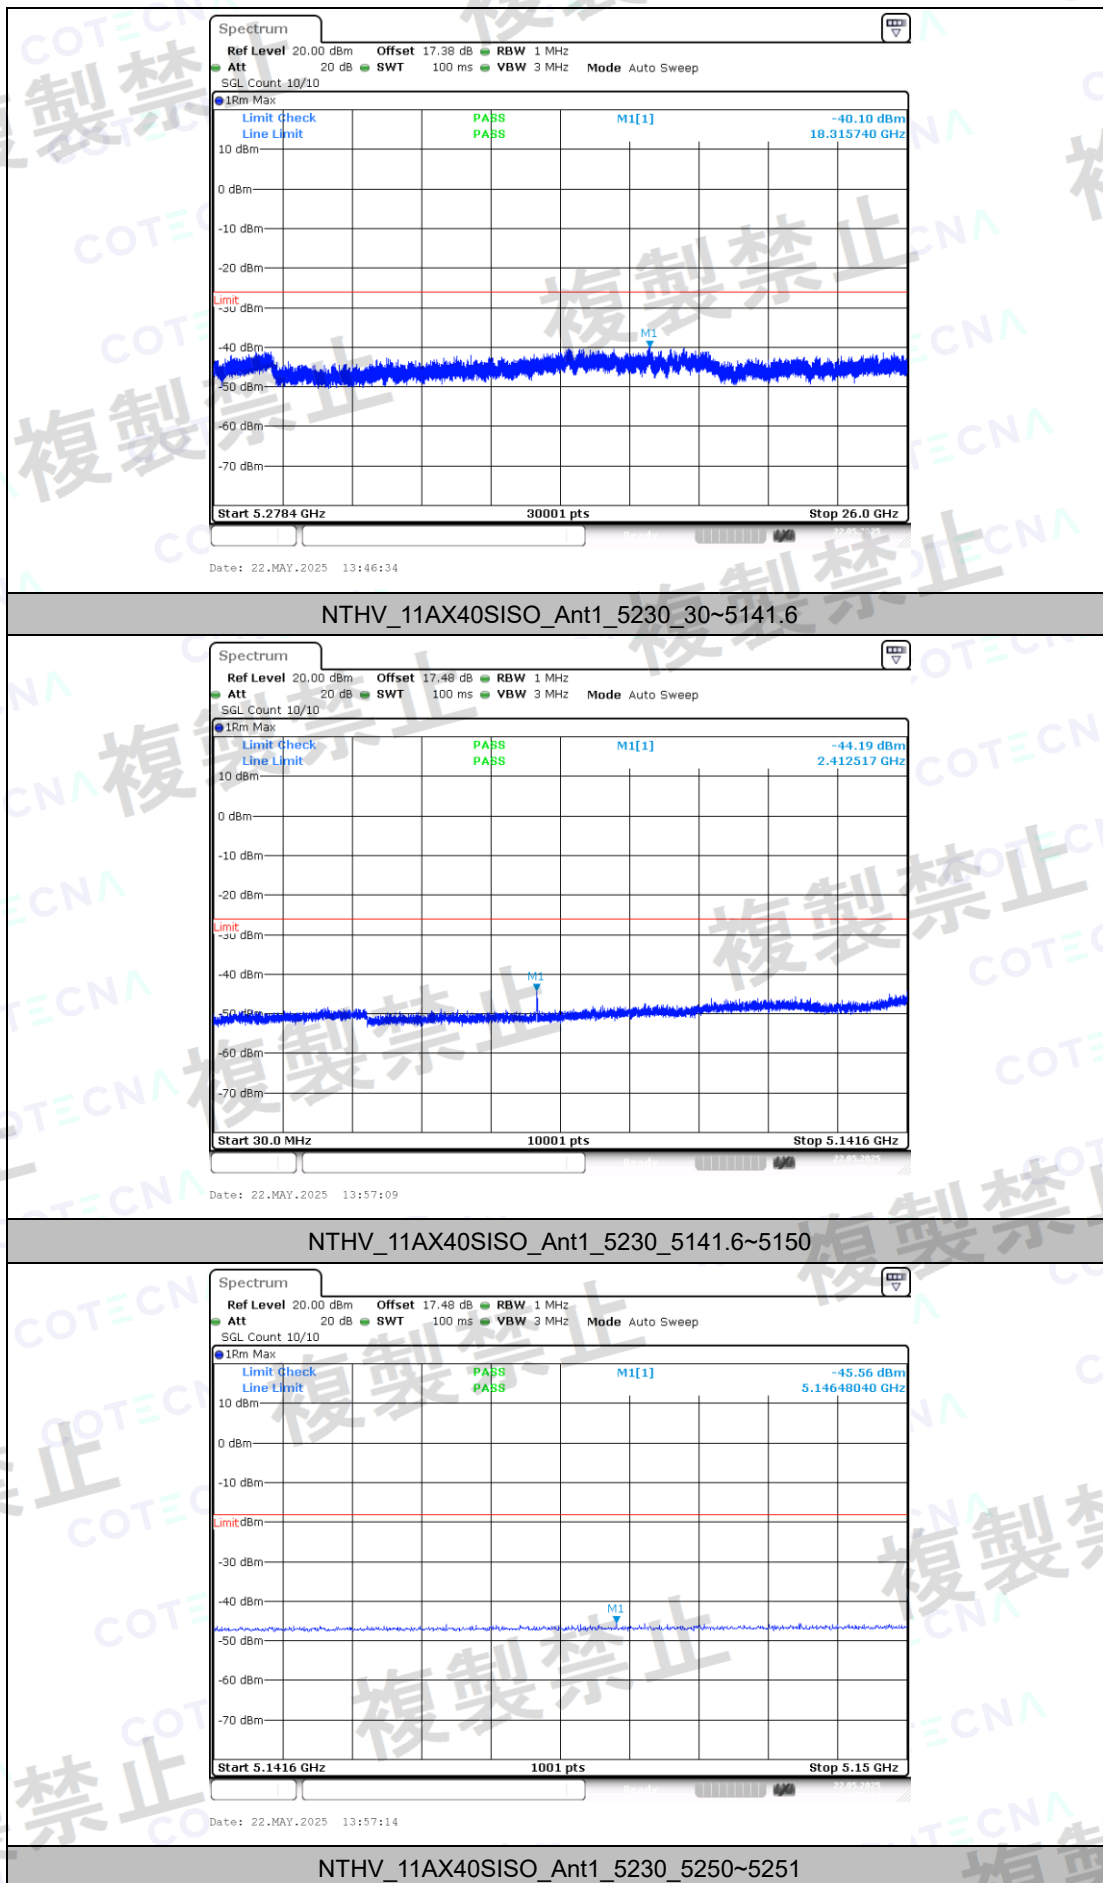


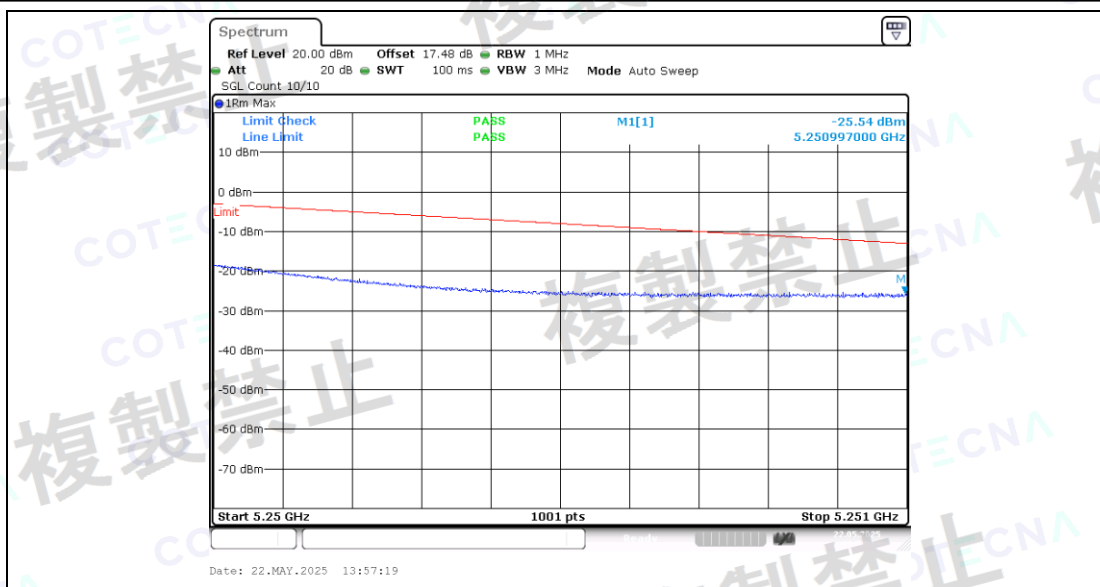

NTHV_11AX40SISO_Ant1_5230_5251~5270

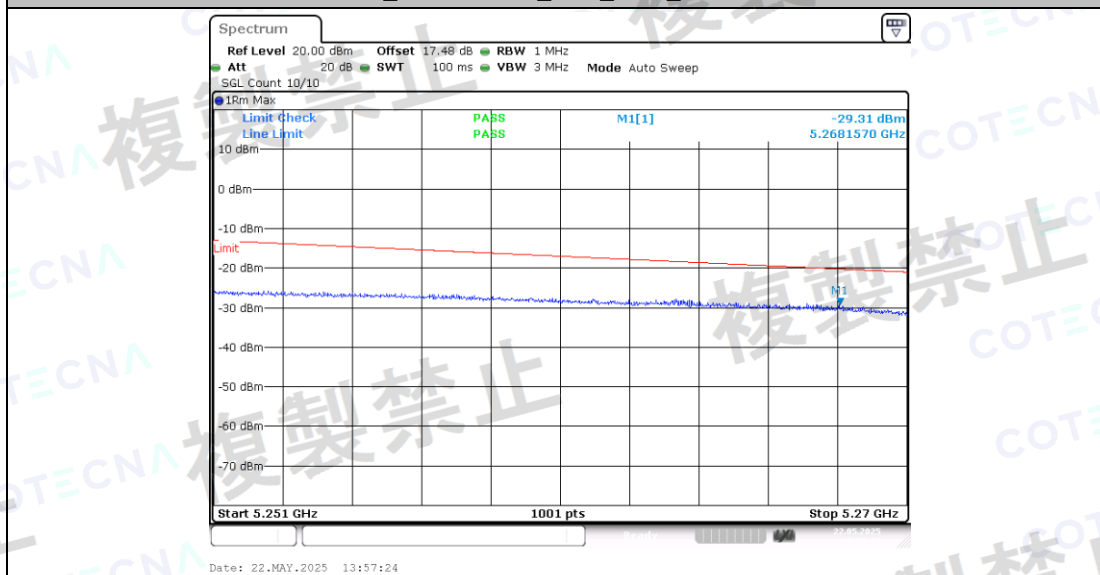



NTHV_11AX40SISO_Ant1_5230_5270~5278.4

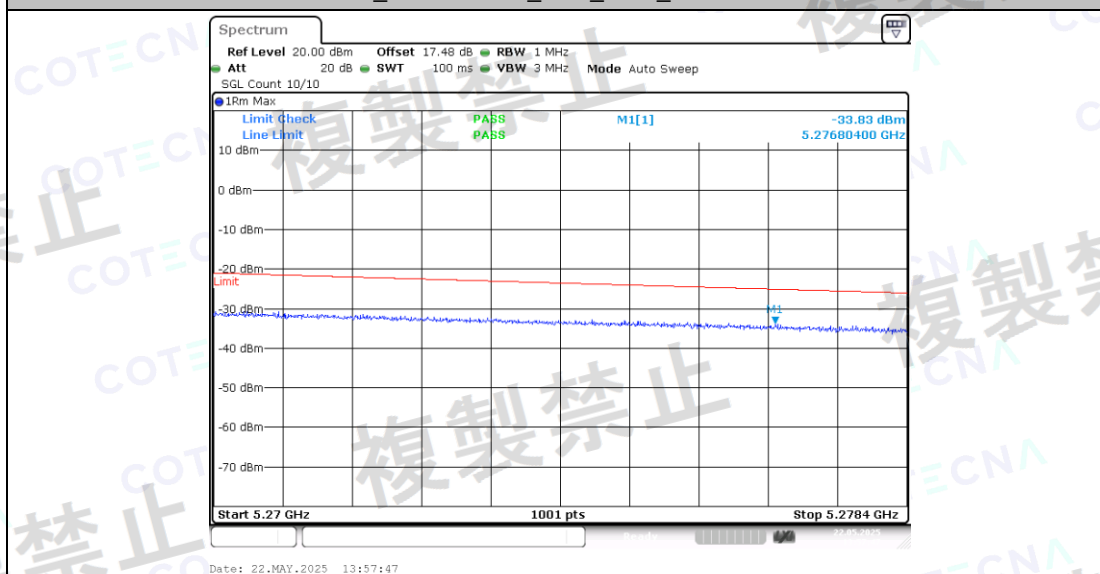


NTHV_11AX40SISO_Ant1_5230_5278.4~26000



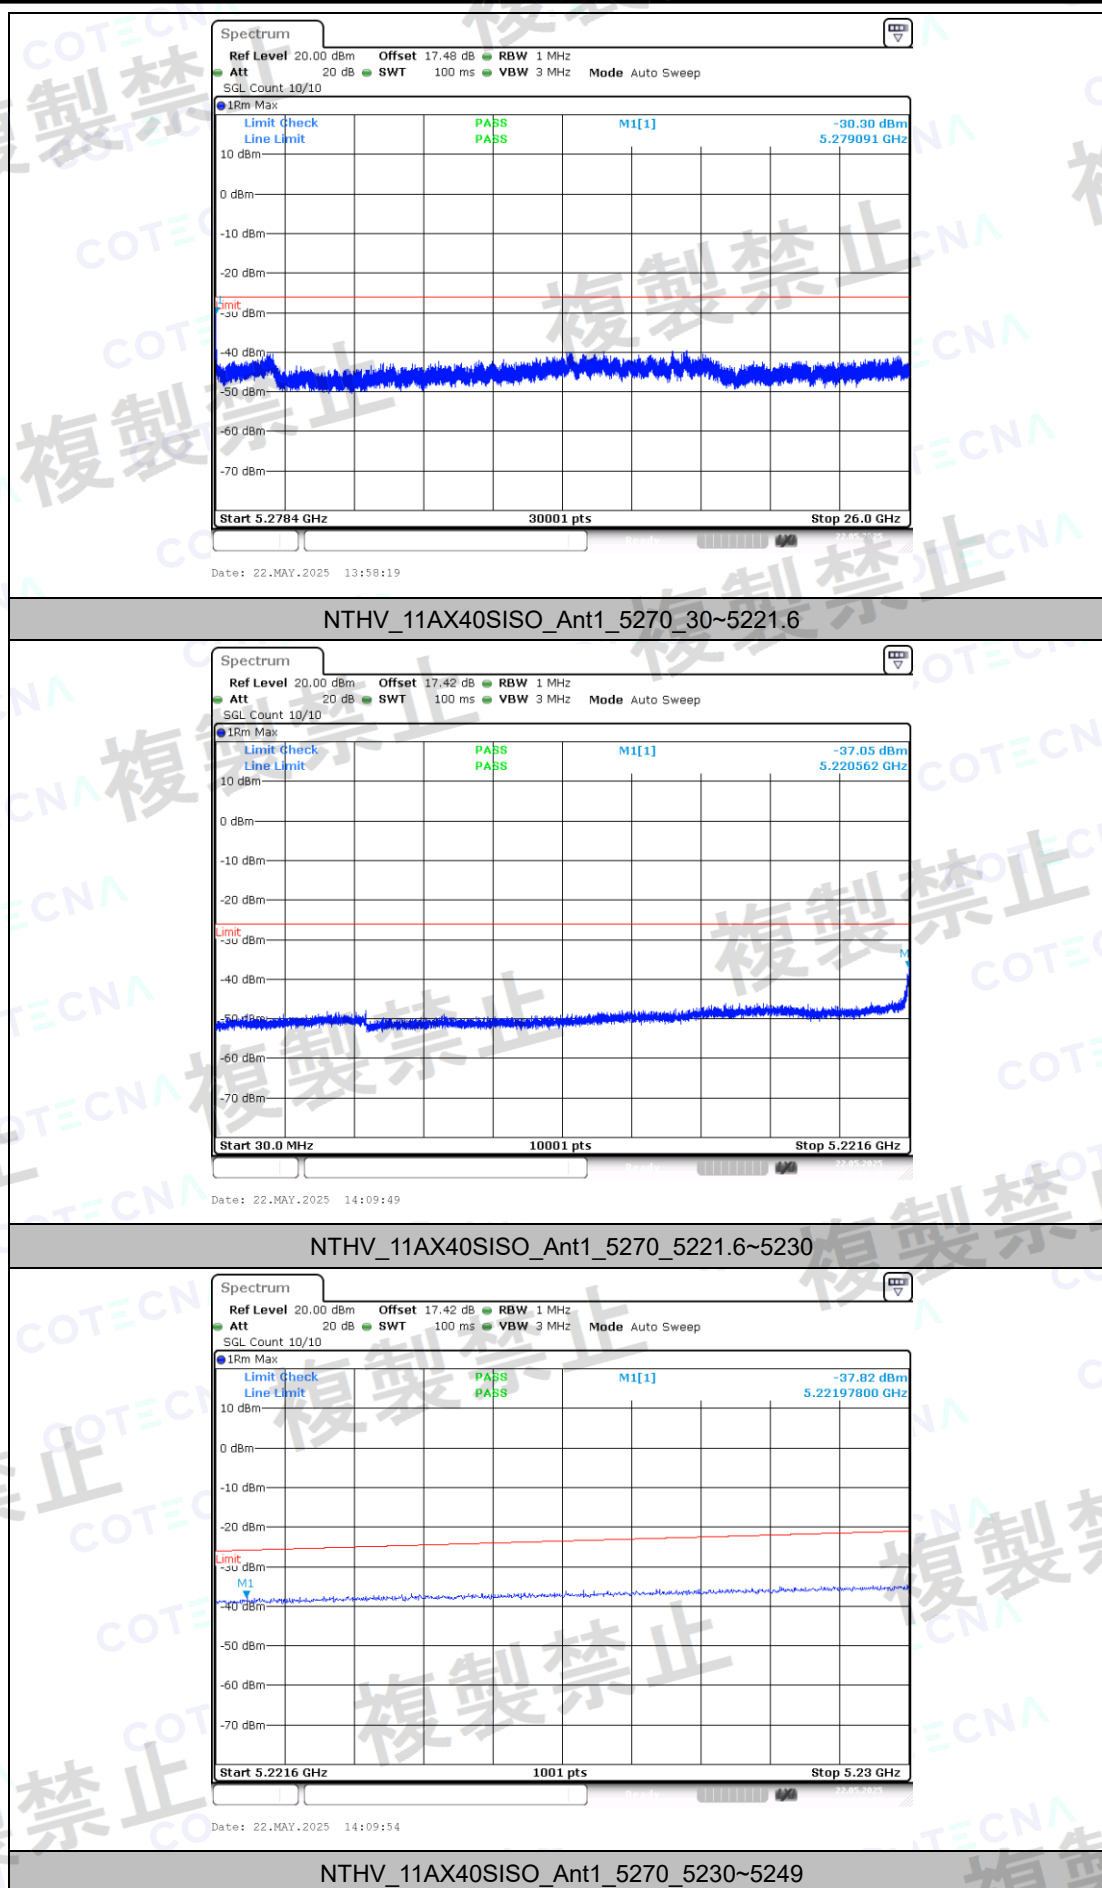


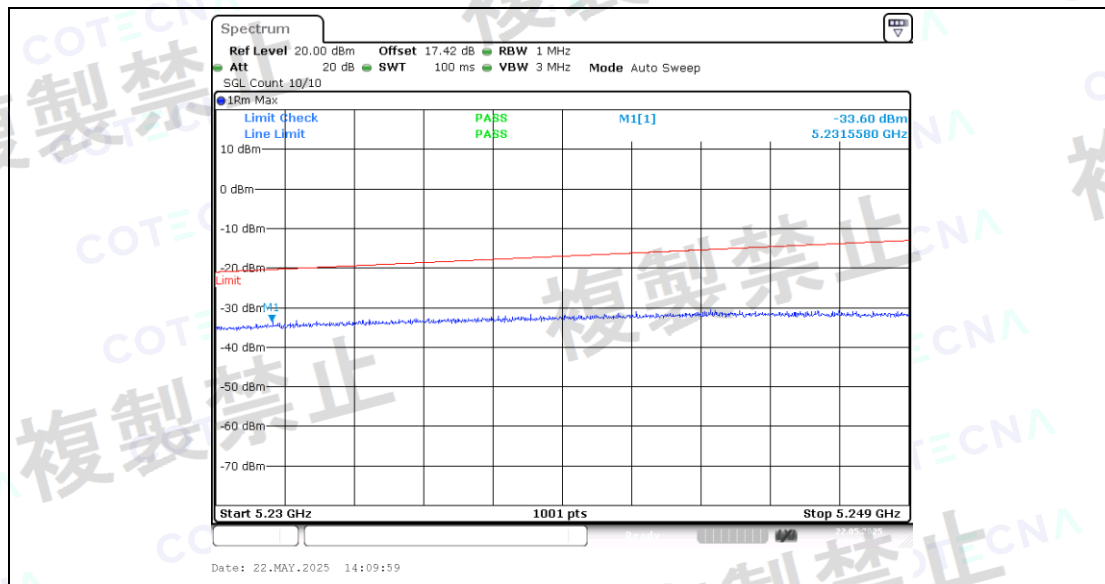

NTHV_11AX40SISO_Ant1_5270_5249~5250

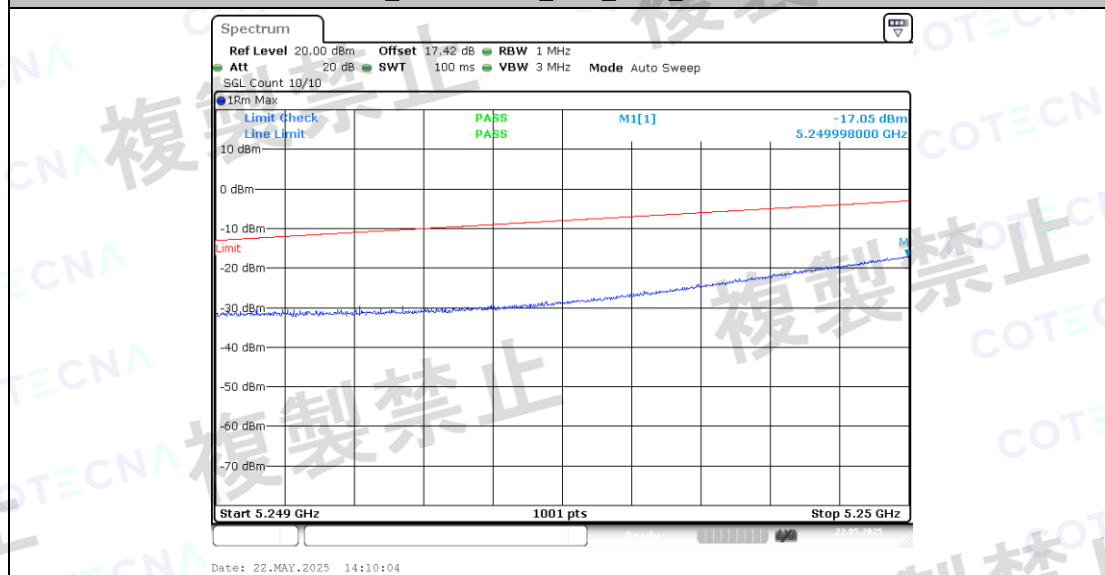


NTHV_11AX40SISO_Ant1_5270_5348.4~26000

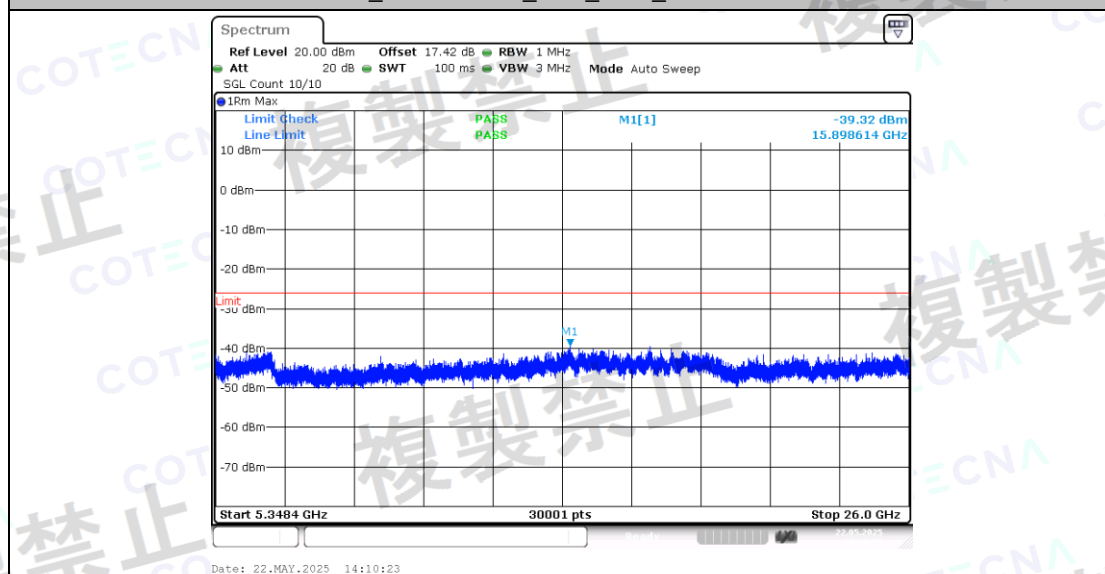


NTHV_11AX40SISO_Ant1_5270_5350~5348.4






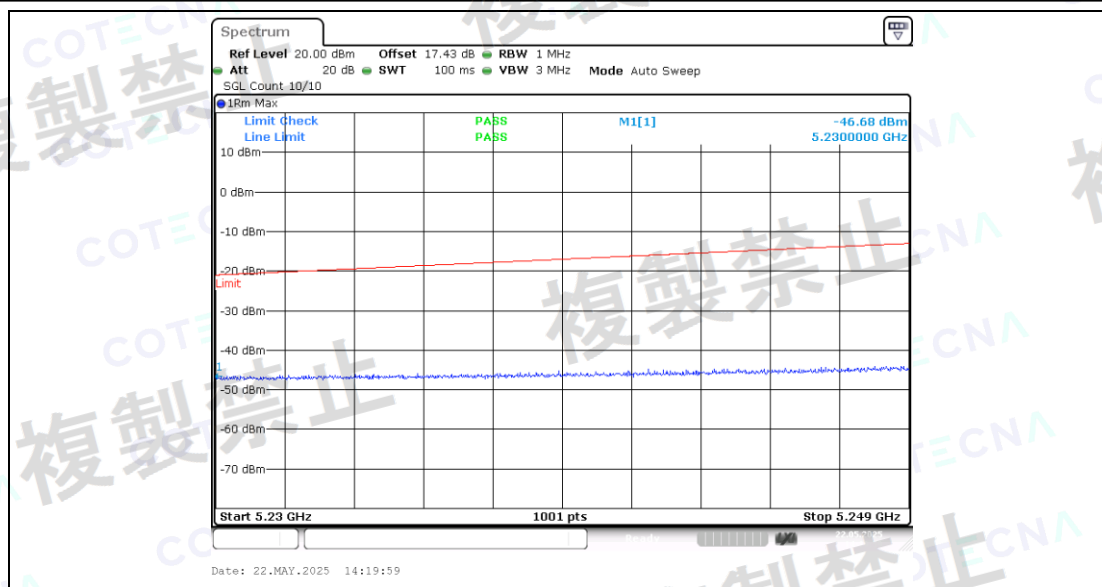

NTHV_11AX40SISO_Ant1_5310_5249~5250

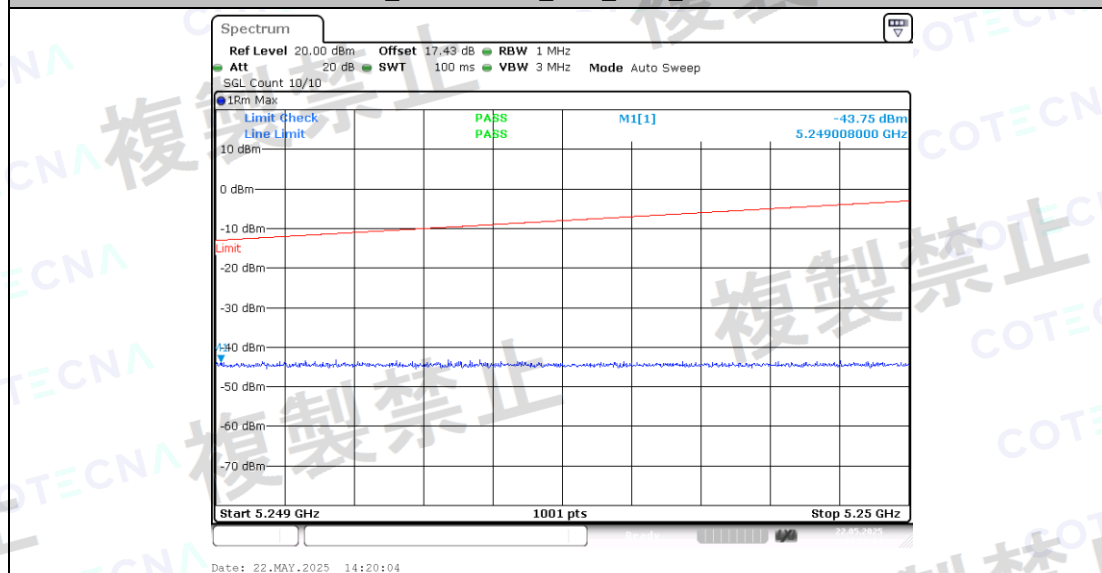


NTHV_11AX40SISO_Ant1_5310_5348.4~26000

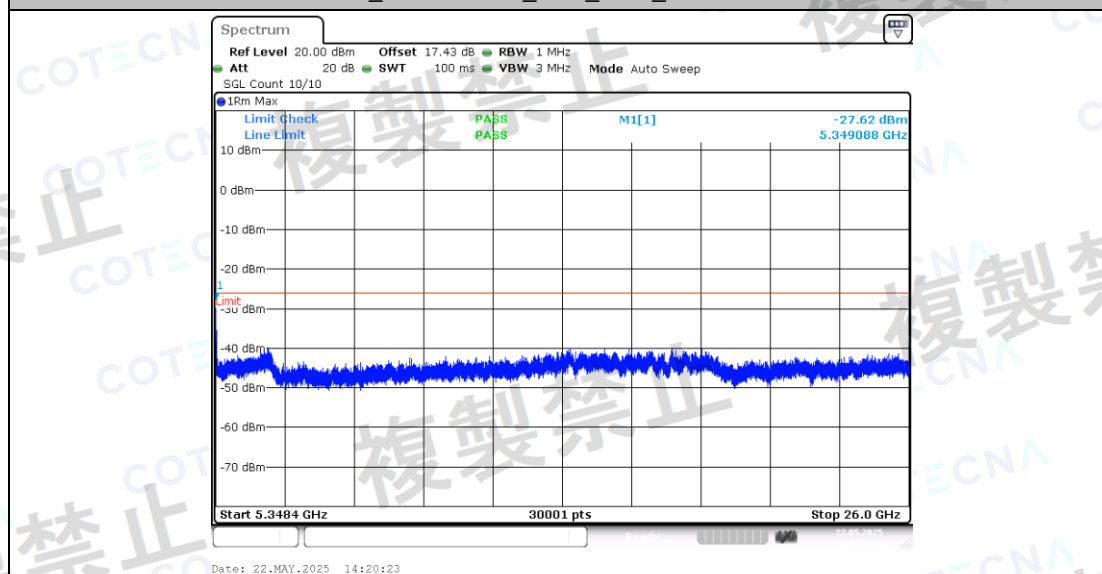


NTHV_11AX40SISO_Ant1_5310_5350~5348.4




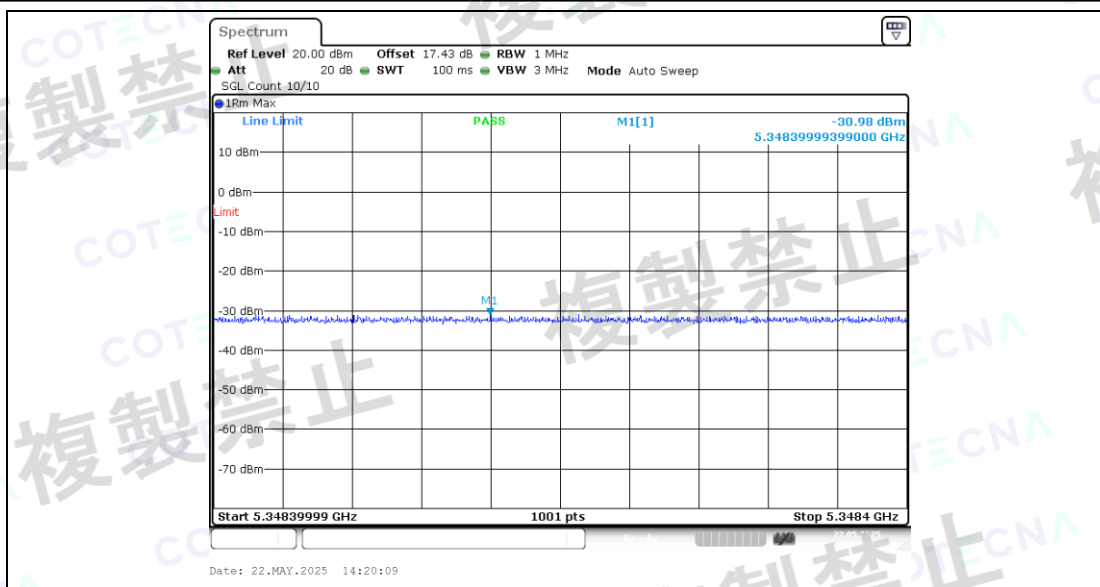

NTHV_11AX40SISO_Ant1_5510_30~5460

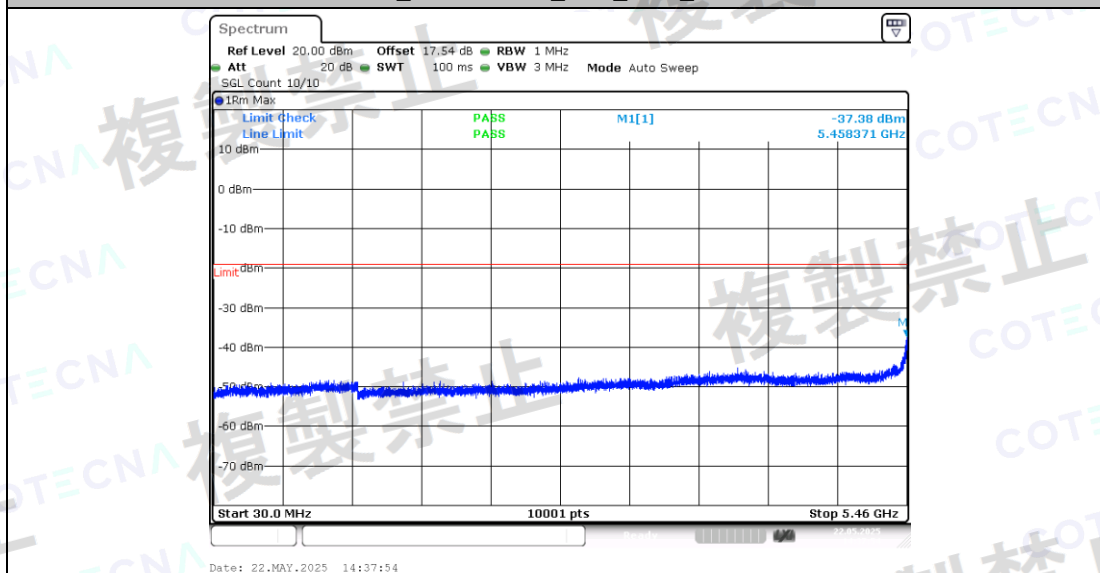


NTHV_11AX40SISO_Ant1_5510_5460~5470

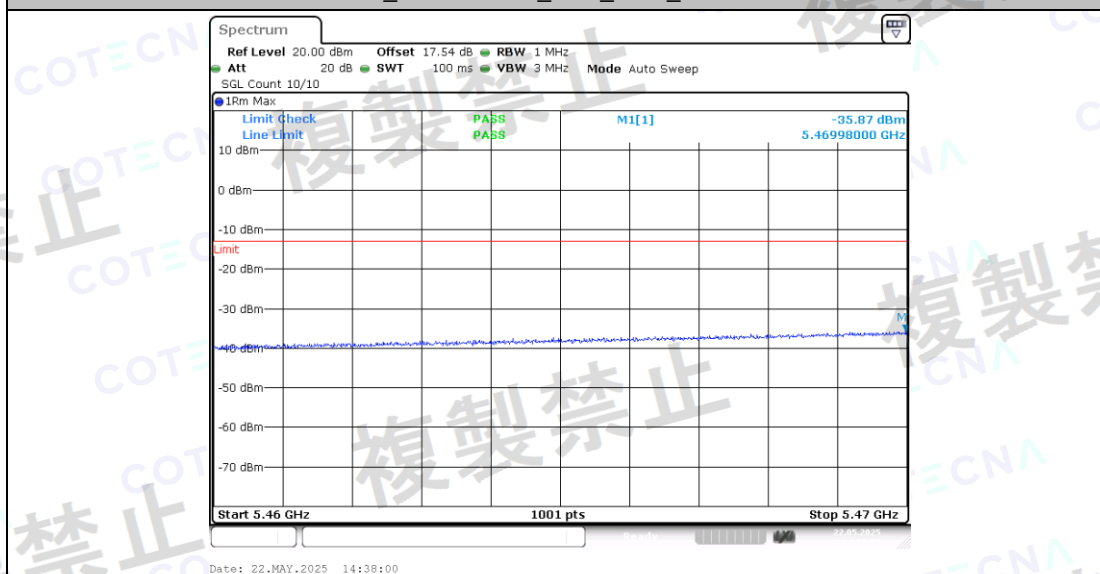


NTHV_11AX40SISO_Ant1_5510_5770~26000






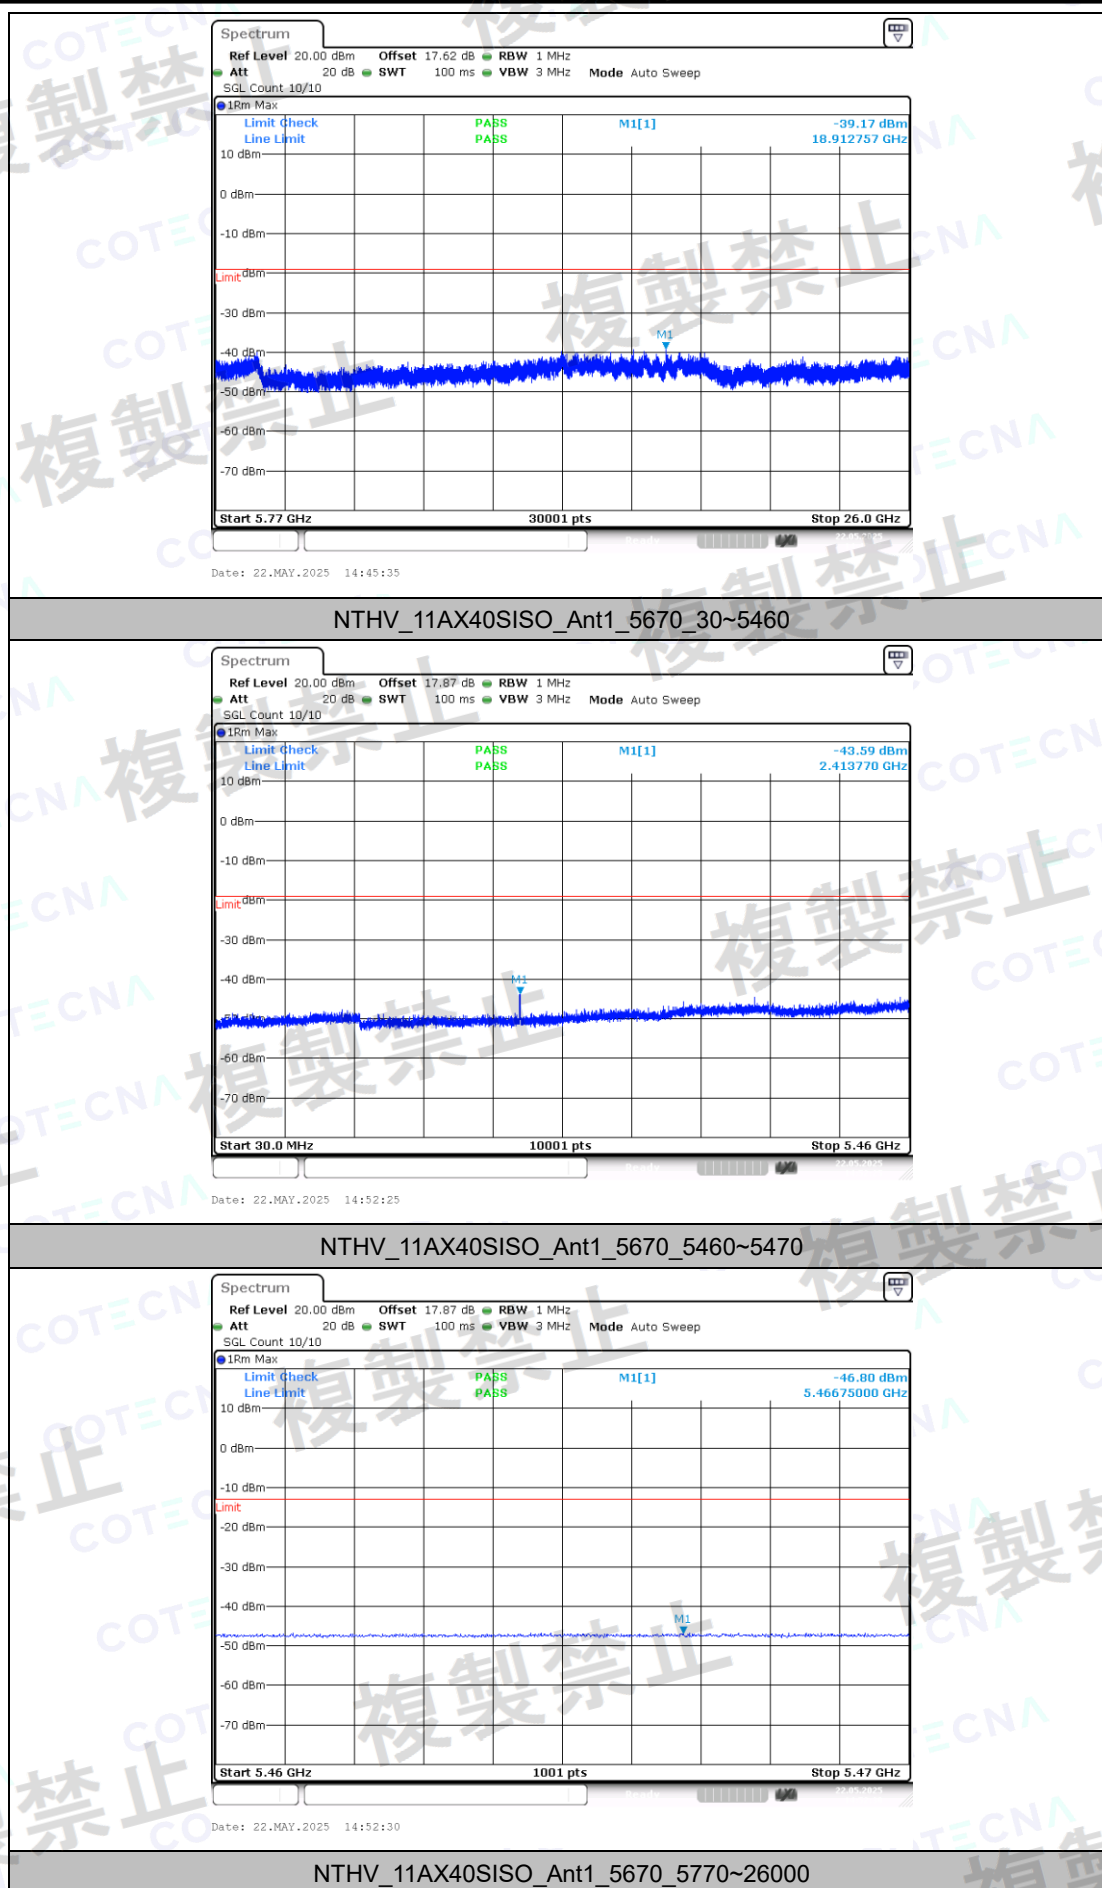




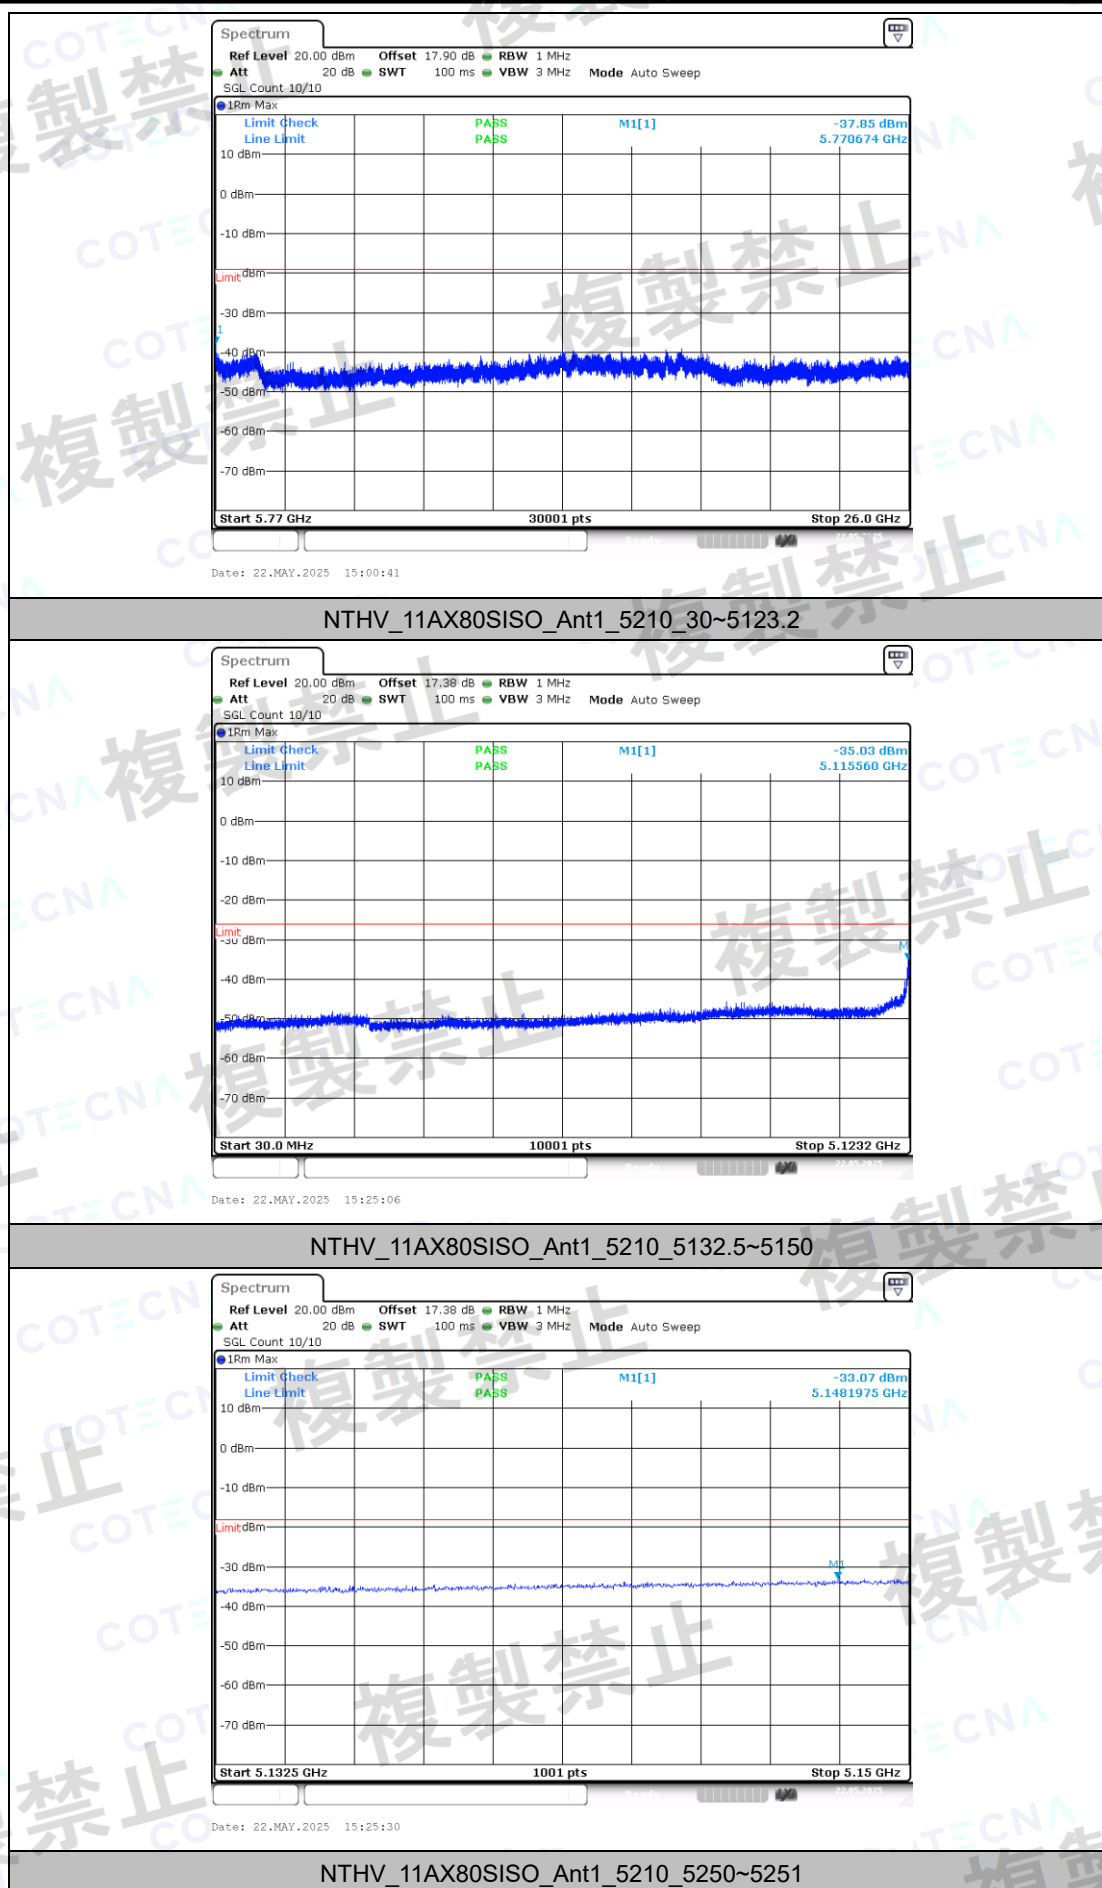


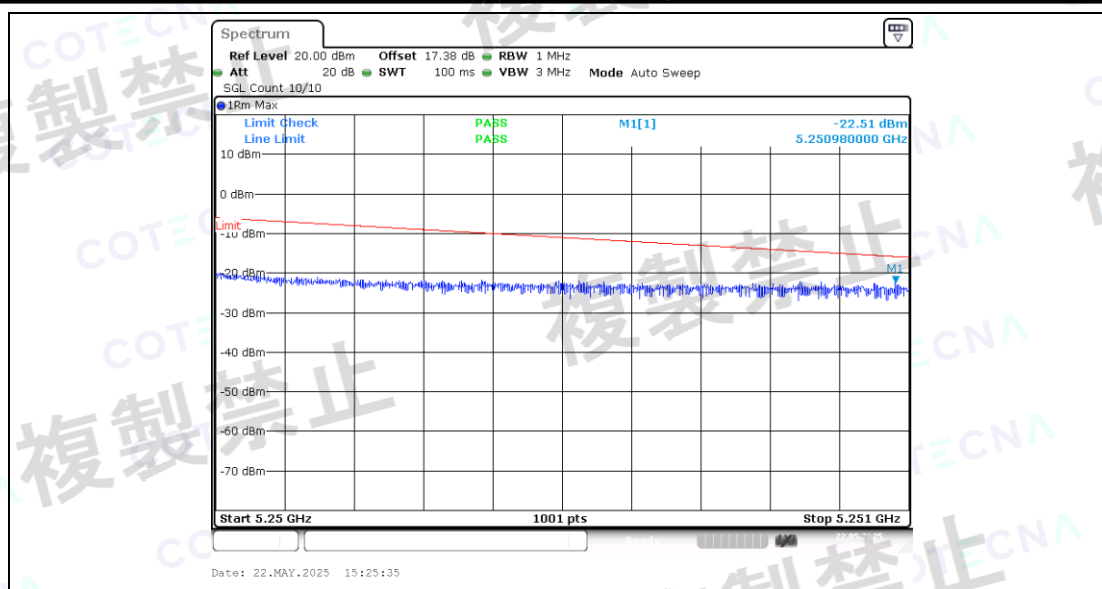

NTHV_11AX80SISO_Ant1_5210_5251~5290

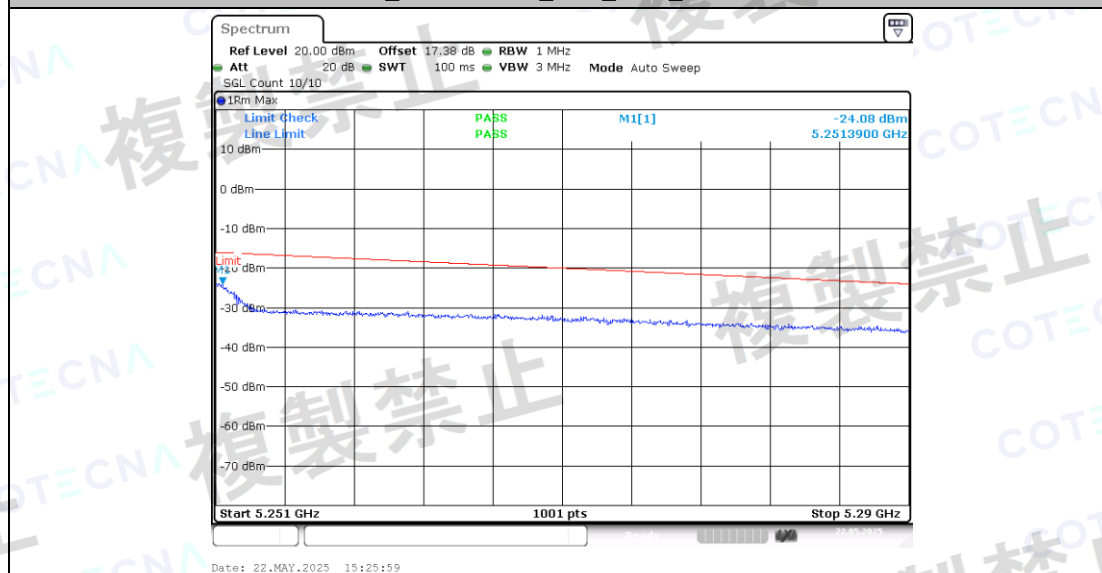


NTHV_11AX80SISO_Ant1_5210_5290~5296.7

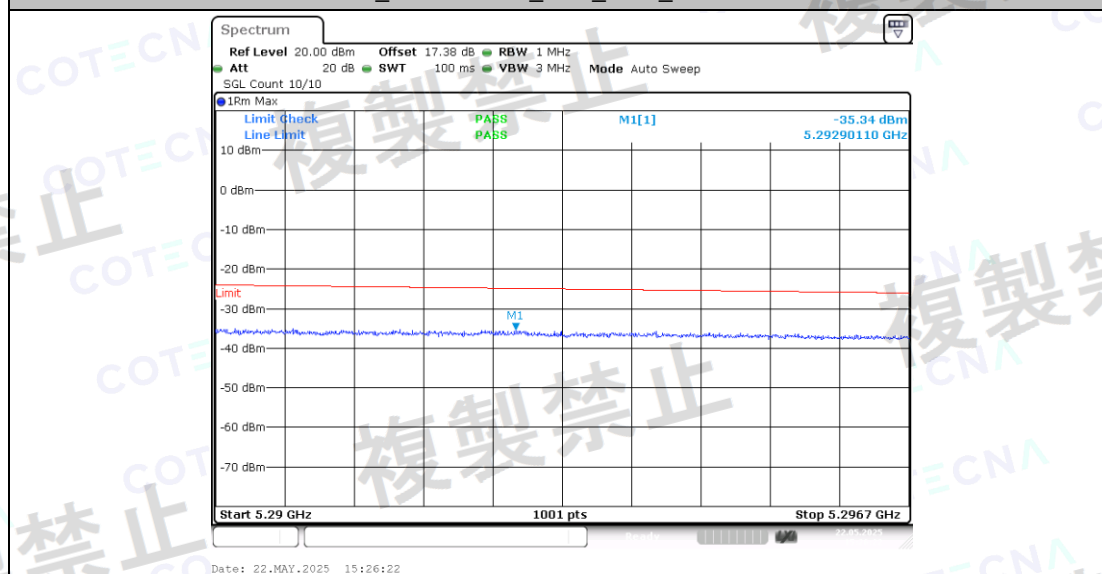



NTHV_11AX80SISO_Ant1_5210_5296.7~26000





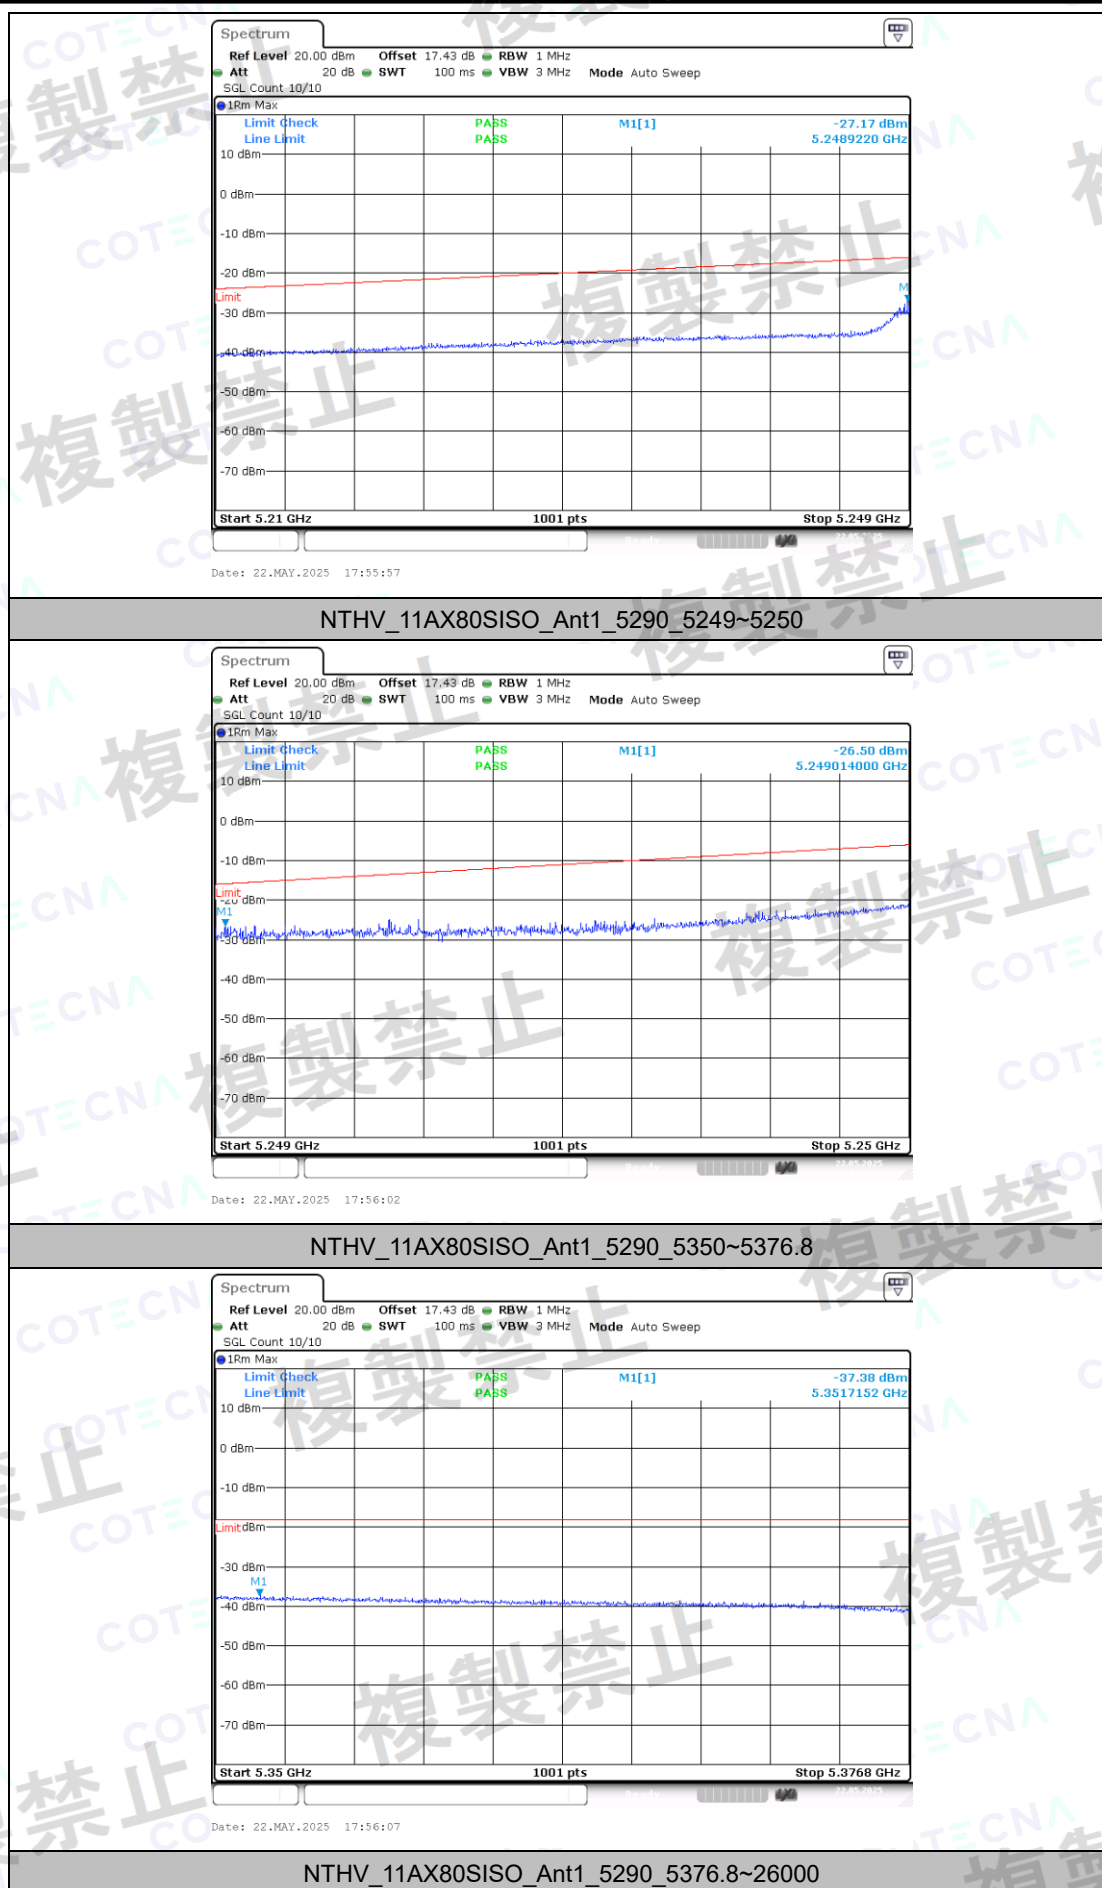


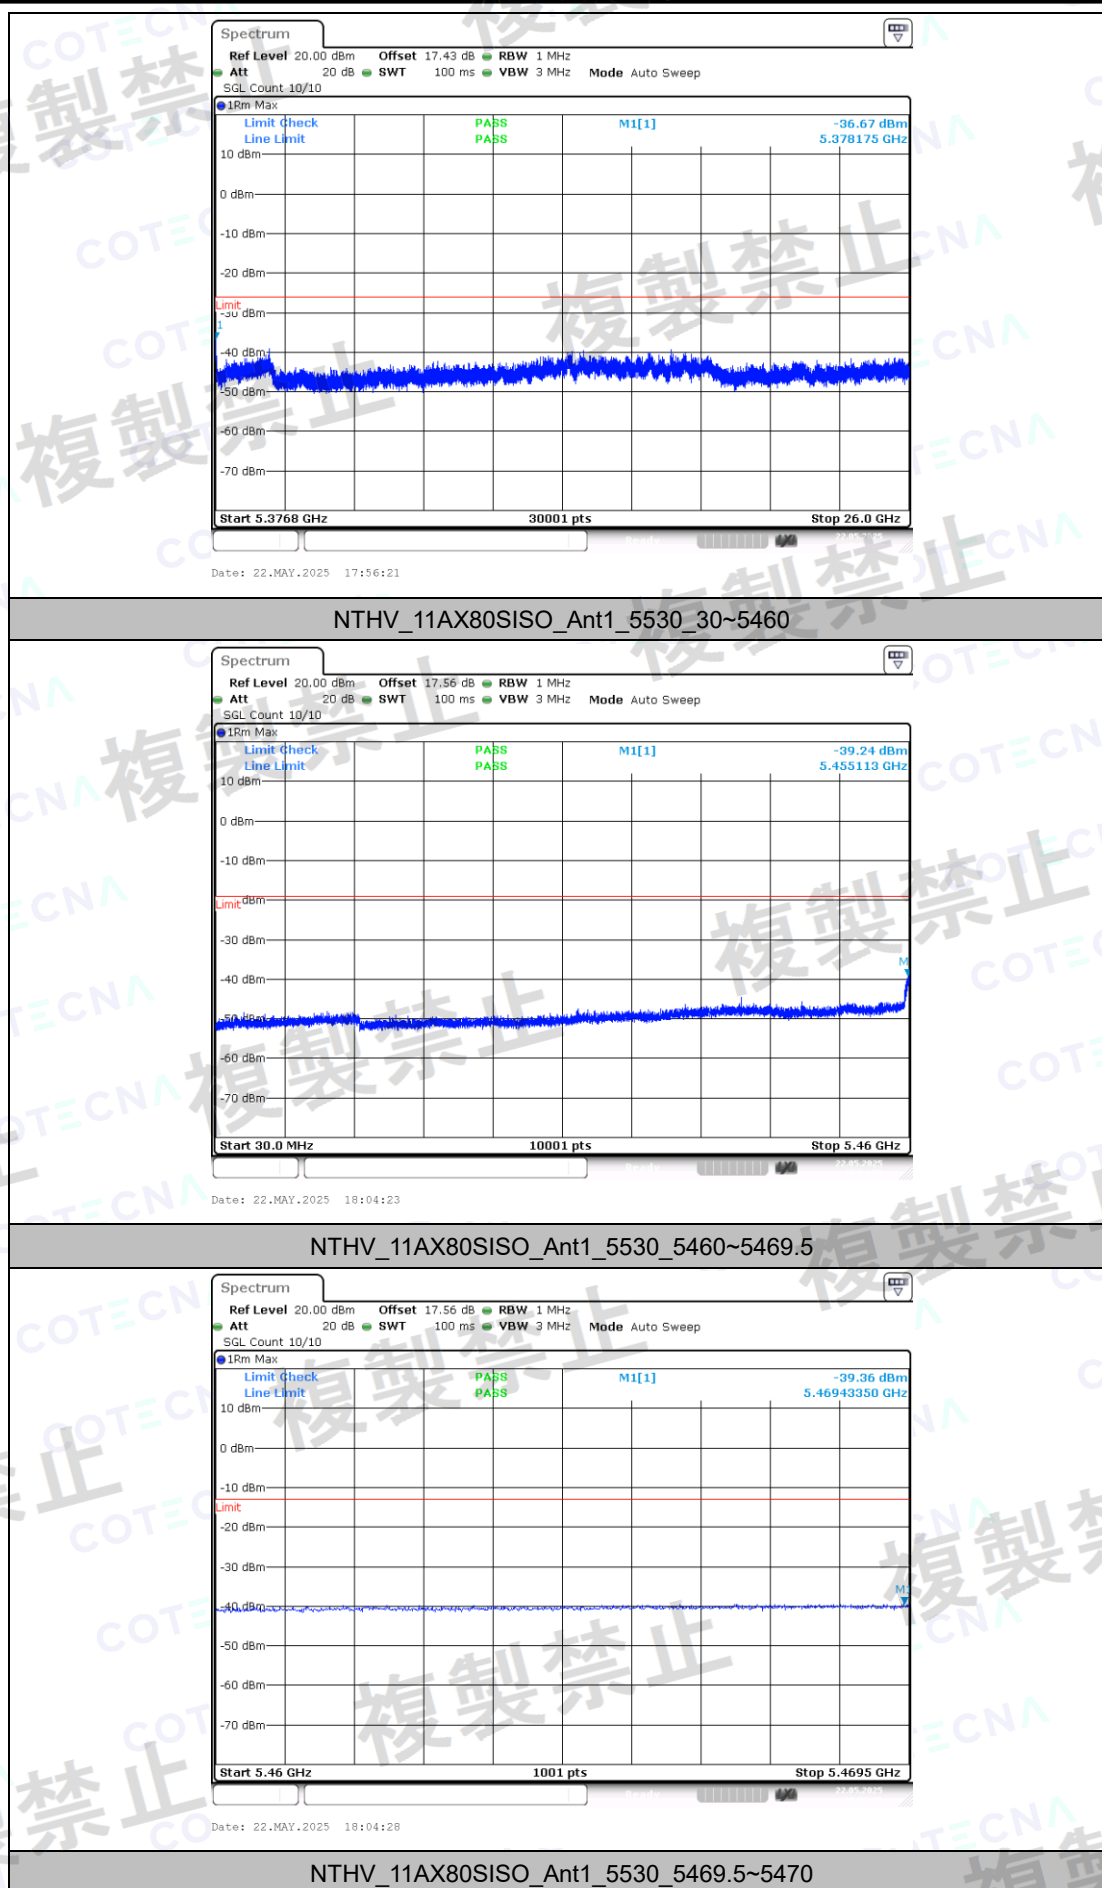

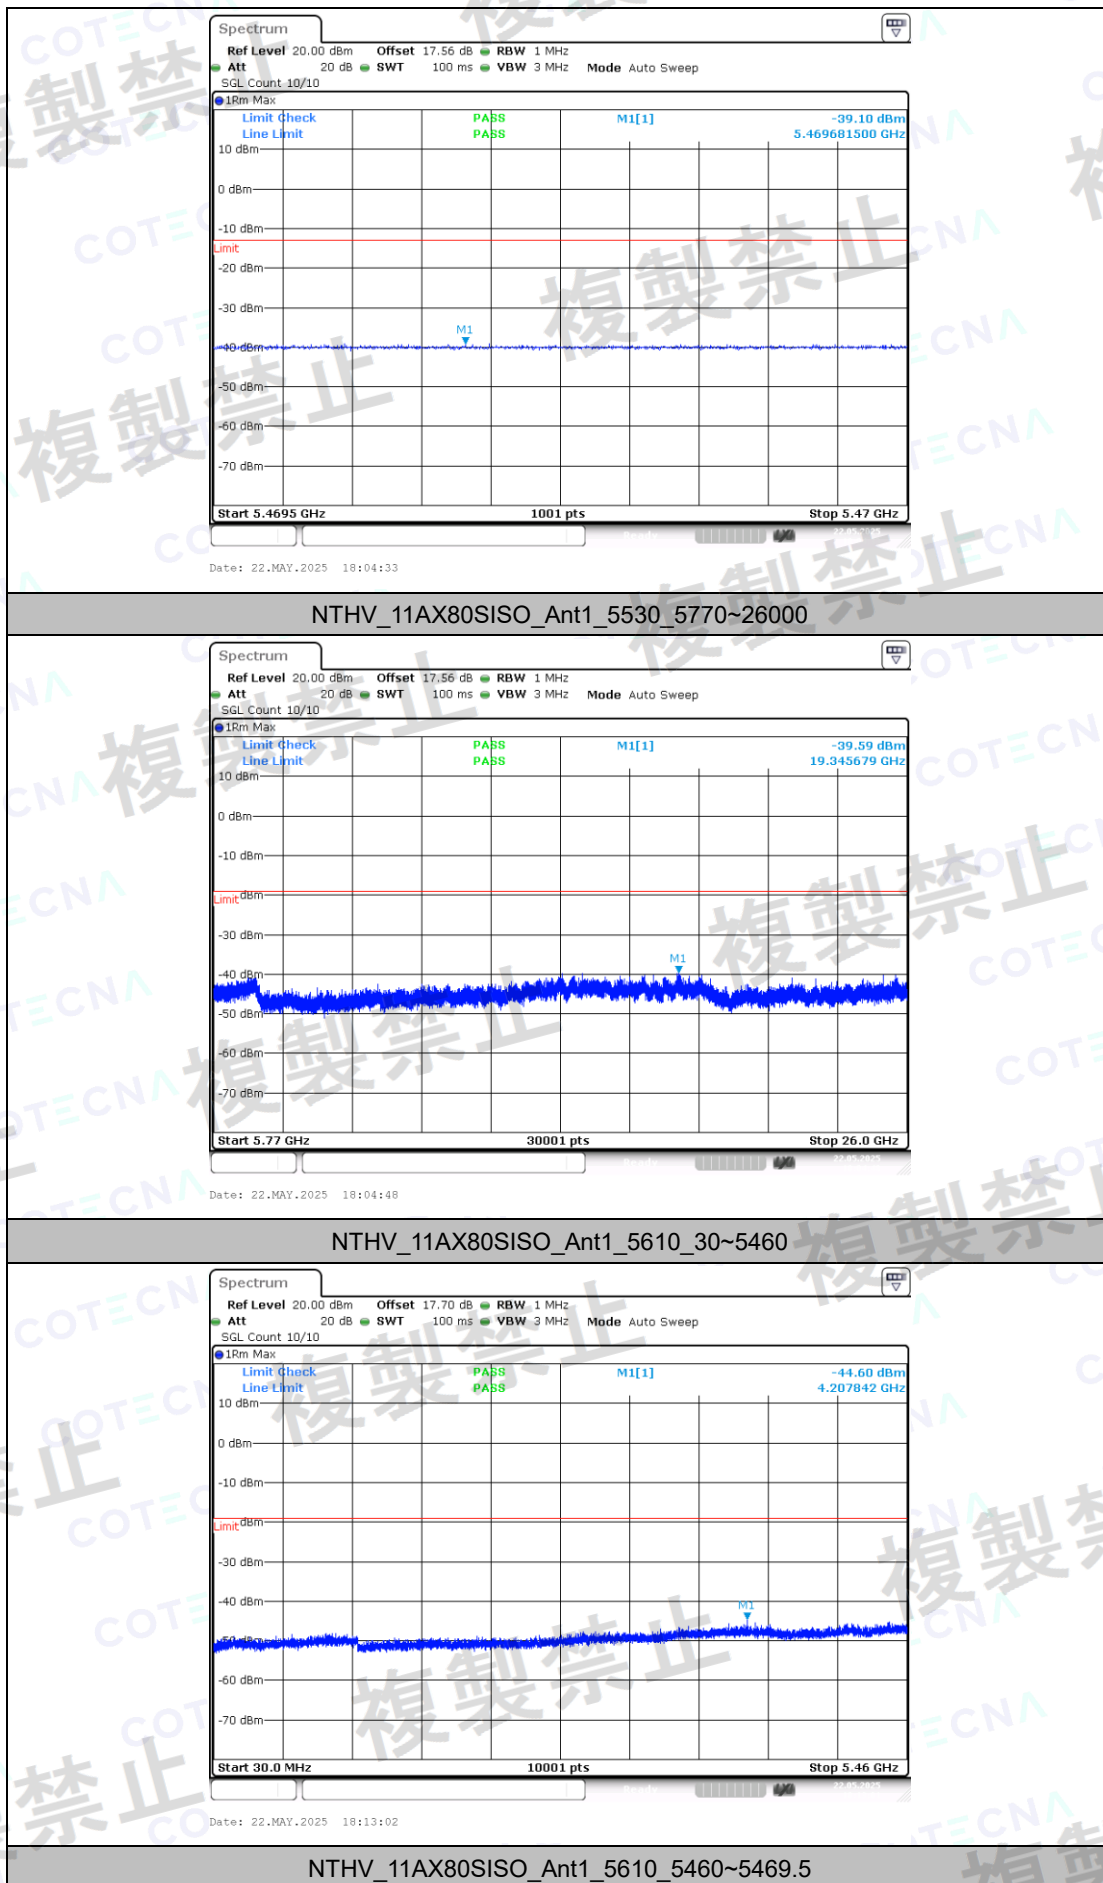





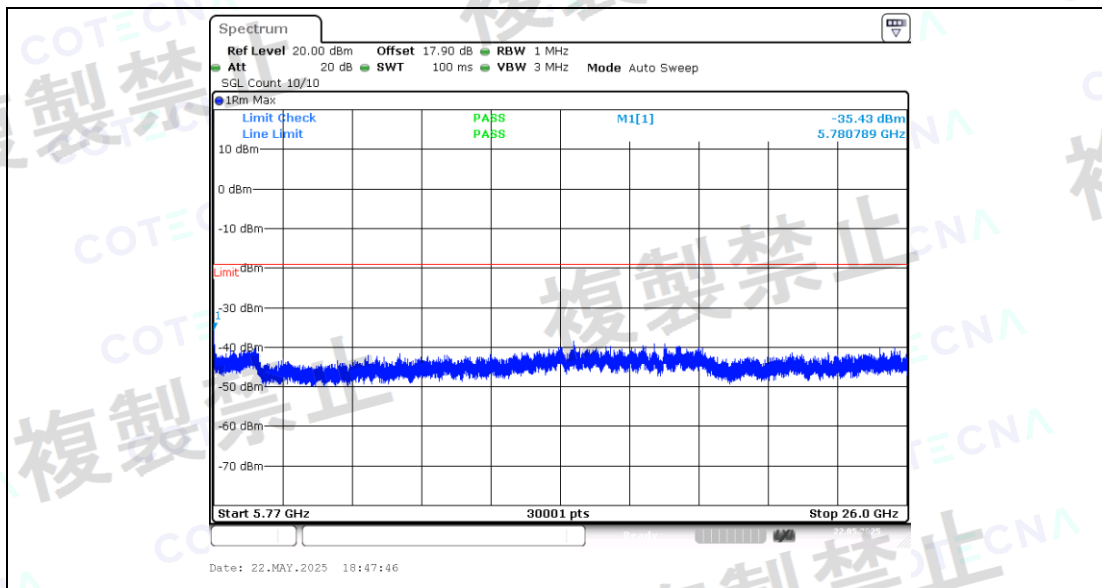

Appendix G: Spurious Emission of RX

Test Result

TestCondition	TestMode	Antenna	Frequency [MHz]	Freq.Range [MHz]	Result [dBm]	Limit [dBm]	Result [nW]	Limit [nW]	Verdict
NTNV	11A	Ant1	5180	30~1000	-75.95	≤-54	0.02541	≤4	PASS
				1000~26000	-59.64	≤-47	1.08643	≤20	PASS
			5200	30~1000	-77.02	≤-54	0.01986	≤4	PASS
				1000~26000	-60.04	≤-47	0.99083	≤20	PASS
			5220	30~1000	-76.66	≤-54	0.02158	≤4	PASS
				1000~26000	-60.41	≤-47	0.90991	≤20	PASS
			5240	30~1000	-76.69	≤-54	0.02143	≤4	PASS
				1000~26000	-60.32	≤-47	0.92897	≤20	PASS
			5260	30~1000	-76.22	≤-54	0.02388	≤4	PASS
				1000~26000	-60.52	≤-47	0.88716	≤20	PASS
			5280	30~1000	-77.17	≤-54	0.01919	≤4	PASS
				1000~26000	-60.20	≤-47	0.95499	≤20	PASS
			5300	30~1000	-76.83	≤-54	0.02075	≤4	PASS
				1000~26000	-55.80	≤-47	2.63027	≤20	PASS
			5320	30~1000	-76.80	≤-54	0.02089	≤4	PASS
				1000~26000	-60.35	≤-47	0.92257	≤20	PASS
			5500	30~1000	-76.27	≤-54	0.02360	≤4	PASS
				1000~26000	-60.24	≤-47	0.94624	≤20	PASS
			5580	30~1000	-76.65	≤-54	0.02163	≤4	PASS
				1000~26000	-60.53	≤-47	0.88512	≤20	PASS
			5600	30~1000	-76.69	≤-54	0.02143	≤4	PASS
				1000~26000	-60.07	≤-47	0.98401	≤20	PASS
			5700	30~1000	-76.37	≤-54	0.02307	≤4	PASS
				1000~26000	-60.02	≤-47	0.99541	≤20	PASS
			5720	30~1000	-76.01	≤-54	0.02506	≤4	PASS
				1000~26000	-59.08	≤-47	1.23595	≤20	PASS
	11N20SIS O	Ant1	5180	30~1000	-76.35	≤-54	0.02317	≤4	PASS
				1000~26000	-60.30	≤-47	0.93325	≤20	PASS
			5200	30~1000	-76.63	≤-54	0.02173	≤4	PASS
				1000~26000	-61.05	≤-47	0.78524	≤20	PASS
			5220	30~1000	-76.57	≤-54	0.02203	≤4	PASS
				1000~26000	-60.55	≤-47	0.88105	≤20	PASS
			5240	30~1000	-77.07	≤-54	0.01963	≤4	PASS
				1000~26000	-60.16	≤-47	0.96383	≤20	PASS
			5260	30~1000	-76.39	≤-54	0.02296	≤4	PASS
				1000~26000	-60.33	≤-47	0.92683	≤20	PASS
			5280	30~1000	-76.71	≤-54	0.02133	≤4	PASS
				1000~26000	-60.53	≤-47	0.88512	≤20	PASS
			5300	30~1000	-76.37	≤-54	0.02307	≤4	PASS
				1000~26000	-60.09	≤-47	0.97949	≤20	PASS



			5320	30~1000	-77.07	≤-54	0.01963	≤4	PASS
				1000~26000	-60.55	≤-47	0.88105	≤20	PASS
			5500	30~1000	-76.40	≤-54	0.02291	≤4	PASS
				1000~26000	-60.62	≤-47	0.86696	≤20	PASS
			5580	30~1000	-76.09	≤-54	0.02460	≤4	PASS
				1000~26000	-60.54	≤-47	0.88308	≤20	PASS
			5600	30~1000	-76.60	≤-54	0.02188	≤4	PASS
				1000~26000	-59.73	≤-47	1.06414	≤20	PASS
			5700	30~1000	-76.20	≤-54	0.02399	≤4	PASS
				1000~26000	-60.41	≤-47	0.90991	≤20	PASS
			5720	30~1000	-76.38	≤-54	0.02301	≤4	PASS
				1000~26000	-60.09	≤-47	0.97949	≤20	PASS
	11N40SIS O	Ant1	5190	30~1000	-77.13	≤-54	0.01936	≤4	PASS
				1000~26000	-60.52	≤-47	0.88716	≤20	PASS
			5230	30~1000	-76.57	≤-54	0.02203	≤4	PASS
				1000~26000	-60.58	≤-47	0.87498	≤20	PASS
			5270	30~1000	-76.65	≤-54	0.02163	≤4	PASS
				1000~26000	-60.29	≤-47	0.93541	≤20	PASS
			5310	30~1000	-76.99	≤-54	0.02000	≤4	PASS
				1000~26000	-60.67	≤-47	0.85704	≤20	PASS
			5510	30~1000	-75.99	≤-54	0.02518	≤4	PASS
				1000~26000	-60.37	≤-47	0.91833	≤20	PASS
			5550	30~1000	-76.55	≤-54	0.02213	≤4	PASS
				1000~26000	-60.10	≤-47	0.97724	≤20	PASS
	11AC20SI SO	Ant1	5670	30~1000	-76.51	≤-54	0.02234	≤4	PASS
				1000~26000	-60.25	≤-47	0.94406	≤20	PASS
			5710	30~1000	-76.13	≤-54	0.02438	≤4	PASS
				1000~26000	-59.78	≤-47	1.05196	≤20	PASS
			5180	30~1000	-76.97	≤-54	0.02009	≤4	PASS
				1000~26000	-59.36	≤-47	1.15878	≤20	PASS
			5200	30~1000	-76.74	≤-54	0.02118	≤4	PASS
				1000~26000	-60.57	≤-47	0.87700	≤20	PASS
			5220	30~1000	-76.57	≤-54	0.02203	≤4	PASS
				1000~26000	-60.24	≤-47	0.94624	≤20	PASS
			5240	30~1000	-76.84	≤-54	0.02070	≤4	PASS
				1000~26000	-60.78	≤-47	0.83560	≤20	PASS
			5260	30~1000	-76.53	≤-54	0.02223	≤4	PASS
				1000~26000	-60.26	≤-47	0.94189	≤20	PASS
			5280	30~1000	-76.93	≤-54	0.02028	≤4	PASS
				1000~26000	-60.63	≤-47	0.86497	≤20	PASS
			5300	30~1000	-77.15	≤-54	0.01928	≤4	PASS
				1000~26000	-60.96	≤-47	0.80168	≤20	PASS
			5320	30~1000	-76.21	≤-54	0.02393	≤4	PASS
				1000~26000	-60.91	≤-47	0.81096	≤20	PASS
			5500	30~1000	-76.44	≤-54	0.02270	≤4	PASS



	11AC40SI SO	Ant1		1000~26000	-60.33	≤ -47	0.92683	≤ 20	PASS
			5580	30~1000	-76.31	≤ -54	0.02339	≤ 4	PASS
				1000~26000	-60.40	≤ -47	0.91201	≤ 20	PASS
			5600	30~1000	-76.77	≤ -54	0.02104	≤ 4	PASS
				1000~26000	-59.98	≤ -47	1.00462	≤ 20	PASS
			5700	30~1000	-76.14	≤ -54	0.02432	≤ 4	PASS
				1000~26000	-60.20	≤ -47	0.95499	≤ 20	PASS
			5720	30~1000	-76.65	≤ -54	0.02163	≤ 4	PASS
				1000~26000	-59.78	≤ -47	1.05196	≤ 20	PASS
			5190	30~1000	-76.76	≤ -54	0.02109	≤ 4	PASS
				1000~26000	-54.45	≤ -47	3.58922	≤ 20	PASS
			5230	30~1000	-76.97	≤ -54	0.02009	≤ 4	PASS
				1000~26000	-60.62	≤ -47	0.86696	≤ 20	PASS
	11AC80SI SO	Ant1	5270	30~1000	-77.15	≤ -54	0.01928	≤ 4	PASS
				1000~26000	-60.53	≤ -47	0.88512	≤ 20	PASS
			5310	30~1000	-76.96	≤ -54	0.02014	≤ 4	PASS
				1000~26000	-60.50	≤ -47	0.89125	≤ 20	PASS
			5510	30~1000	-75.96	≤ -54	0.02535	≤ 4	PASS
				1000~26000	-60.44	≤ -47	0.90365	≤ 20	PASS
			5550	30~1000	-76.66	≤ -54	0.02158	≤ 4	PASS
				1000~26000	-60.20	≤ -47	0.95499	≤ 20	PASS
			5670	30~1000	-76.22	≤ -54	0.02388	≤ 4	PASS
				1000~26000	-60.19	≤ -47	0.95719	≤ 20	PASS
			5710	30~1000	-76.44	≤ -54	0.02270	≤ 4	PASS
				1000~26000	-58.85	≤ -47	1.30317	≤ 20	PASS
			5210	30~1000	-76.53	≤ -54	0.02223	≤ 4	PASS
				1000~26000	-60.68	≤ -47	0.85507	≤ 20	PASS
	11AX20SIS O	Ant1	5290	30~1000	-76.25	≤ -54	0.02371	≤ 4	PASS
				1000~26000	-60.71	≤ -47	0.84918	≤ 20	PASS
			5530	30~1000	-76.57	≤ -54	0.02203	≤ 4	PASS
				1000~26000	-60.13	≤ -47	0.97051	≤ 20	PASS
			5610	30~1000	-76.48	≤ -54	0.02249	≤ 4	PASS
				1000~26000	-60.26	≤ -47	0.94189	≤ 20	PASS
			5690	30~1000	-76.39	≤ -54	0.02296	≤ 4	PASS
				1000~26000	-59.91	≤ -47	1.02094	≤ 20	PASS
			5180	30~1000	-76.81	≤ -54	0.02084	≤ 4	PASS
				1000~26000	-60.31	≤ -47	0.93111	≤ 20	PASS
			5200	30~1000	-76.80	≤ -54	0.02089	≤ 4	PASS
				1000~26000	-59.62	≤ -47	1.09144	≤ 20	PASS
			5220	30~1000	-77.24	≤ -54	0.01888	≤ 4	PASS
				1000~26000	-60.42	≤ -47	0.90782	≤ 20	PASS
			5240	30~1000	-76.67	≤ -54	0.02153	≤ 4	PASS
				1000~26000	-59.55	≤ -47	1.10917	≤ 20	PASS
			5260	30~1000	-77.08	≤ -54	0.01959	≤ 4	PASS
				1000~26000	-60.43	≤ -47	0.90573	≤ 20	PASS



			5280	30~1000	-77.24	≤-54	0.01888	≤4	PASS
				1000~26000	-60.61	≤-47	0.86896	≤20	PASS
			5300	30~1000	-75.88	≤-54	0.02582	≤4	PASS
				1000~26000	-60.44	≤-47	0.90365	≤20	PASS
			5320	30~1000	-76.77	≤-54	0.02104	≤4	PASS
				1000~26000	-60.58	≤-47	0.87498	≤20	PASS
			5500	30~1000	-76.93	≤-54	0.02028	≤4	PASS
				1000~26000	-60.15	≤-47	0.96605	≤20	PASS
			5580	30~1000	-76.52	≤-54	0.02228	≤4	PASS
				1000~26000	-59.93	≤-47	1.01625	≤20	PASS
			5600	30~1000	-76.96	≤-54	0.02014	≤4	PASS
				1000~26000	-60.27	≤-47	0.93972	≤20	PASS
			5700	30~1000	-75.99	≤-54	0.02518	≤4	PASS
				1000~26000	-60.38	≤-47	0.91622	≤20	PASS
			5720	30~1000	-74.99	≤-54	0.03170	≤4	PASS
				1000~26000	-59.72	≤-47	1.06660	≤20	PASS
	11AX40SIS O	Ant1	5190	30~1000	-76.69	≤-54	0.02143	≤4	PASS
				1000~26000	-60.33	≤-47	0.92683	≤20	PASS
			5230	30~1000	-77.07	≤-54	0.01963	≤4	PASS
				1000~26000	-60.53	≤-47	0.88512	≤20	PASS
			5270	30~1000	-75.72	≤-54	0.02679	≤4	PASS
				1000~26000	-60.72	≤-47	0.84723	≤20	PASS
			5310	30~1000	-76.91	≤-54	0.02037	≤4	PASS
				1000~26000	-59.47	≤-47	1.12980	≤20	PASS
			5510	30~1000	-76.85	≤-54	0.02065	≤4	PASS
				1000~26000	-60.73	≤-47	0.84528	≤20	PASS
			5550	30~1000	-76.89	≤-54	0.02046	≤4	PASS
				1000~26000	-60.38	≤-47	0.91622	≤20	PASS
			5670	30~1000	-76.69	≤-54	0.02143	≤4	PASS
				1000~26000	-59.69	≤-47	1.07399	≤20	PASS
			5710	30~1000	-76.09	≤-54	0.02460	≤4	PASS
				1000~26000	-60.06	≤-47	0.98628	≤20	PASS
	11AX80SIS O	Ant1	5210	30~1000	-76.28	≤-54	0.02355	≤4	PASS
				1000~26000	-60.39	≤-47	0.91411	≤20	PASS
			5290	30~1000	-77.03	≤-54	0.01982	≤4	PASS
				1000~26000	-60.72	≤-47	0.84723	≤20	PASS
			5530	30~1000	-76.85	≤-54	0.02065	≤4	PASS
				1000~26000	-60.55	≤-47	0.88105	≤20	PASS
			5610	30~1000	-76.11	≤-54	0.02449	≤4	PASS
				1000~26000	-60.21	≤-47	0.95280	≤20	PASS
			5690	30~1000	-76.56	≤-54	0.02208	≤4	PASS
				1000~26000	-60.12	≤-47	0.97275	≤20	PASS
NTLV	11A	Ant1	5180	30~1000	-77.06	≤-54	0.01968	≤4	PASS
				1000~26000	-59.35	≤-47	1.16145	≤20	PASS
			5200	30~1000	-76.95	≤-54	0.02018	≤4	PASS



				1000~26000	-60.73	≤-47	0.84528	≤20	PASS
			5220	30~1000	-76.87	≤-54	0.02056	≤4	PASS
				1000~26000	-60.37	≤-47	0.91833	≤20	PASS
			5240	30~1000	-77.48	≤-54	0.01786	≤4	PASS
				1000~26000	-60.96	≤-47	0.80168	≤20	PASS
			5260	30~1000	-76.16	≤-54	0.02421	≤4	PASS
				1000~26000	-61.15	≤-47	0.76736	≤20	PASS
			5280	30~1000	-76.15	≤-54	0.02427	≤4	PASS
				1000~26000	-60.61	≤-47	0.86896	≤20	PASS
			5300	30~1000	-76.13	≤-54	0.02438	≤4	PASS
				1000~26000	-60.33	≤-47	0.92683	≤20	PASS
			5320	30~1000	-77.07	≤-54	0.01963	≤4	PASS
				1000~26000	-60.21	≤-47	0.95280	≤20	PASS
			5500	30~1000	-76.93	≤-54	0.02028	≤4	PASS
				1000~26000	-59.76	≤-47	1.05682	≤20	PASS
			5580	30~1000	-75.99	≤-54	0.02518	≤4	PASS
				1000~26000	-59.29	≤-47	1.17761	≤20	PASS
			5600	30~1000	-77.01	≤-54	0.01991	≤4	PASS
				1000~26000	-60.25	≤-47	0.94406	≤20	PASS
			5700	30~1000	-76.40	≤-54	0.02291	≤4	PASS
				1000~26000	-60.34	≤-47	0.92470	≤20	PASS
			5720	30~1000	-59.08	≤-54	1.23595	≤4	PASS
				1000~26000	-60.07	≤-47	0.98401	≤20	PASS
	11N20SIS O	Ant1	5180	30~1000	-76.48	≤-54	0.02249	≤4	PASS
				1000~26000	-60.45	≤-47	0.90157	≤20	PASS
			5200	30~1000	-76.90	≤-54	0.02042	≤4	PASS
				1000~26000	-60.34	≤-47	0.92470	≤20	PASS
			5220	30~1000	-76.27	≤-54	0.02360	≤4	PASS
				1000~26000	-60.06	≤-47	0.98628	≤20	PASS
			5240	30~1000	-76.88	≤-54	0.02051	≤4	PASS
				1000~26000	-60.56	≤-47	0.87902	≤20	PASS
			5260	30~1000	-76.38	≤-54	0.02301	≤4	PASS
				1000~26000	-60.39	≤-47	0.91411	≤20	PASS
			5280	30~1000	-76.75	≤-54	0.02113	≤4	PASS
				1000~26000	-60.45	≤-47	0.90157	≤20	PASS
			5300	30~1000	-76.40	≤-54	0.02291	≤4	PASS
				1000~26000	-60.83	≤-47	0.82604	≤20	PASS
			5320	30~1000	-76.45	≤-54	0.02265	≤4	PASS
				1000~26000	-60.28	≤-47	0.93756	≤20	PASS
			5500	30~1000	-76.38	≤-54	0.02301	≤4	PASS
				1000~26000	-60.63	≤-47	0.86497	≤20	PASS
			5580	30~1000	-76.77	≤-54	0.02104	≤4	PASS
				1000~26000	-60.29	≤-47	0.93541	≤20	PASS
			5600	30~1000	-76.70	≤-54	0.02138	≤4	PASS
				1000~26000	-60.80	≤-47	0.83176	≤20	PASS



	11N40SIS O	Ant1	5700	30~1000	-76.03	≤-54	0.02495	≤4	PASS
				1000~26000	-60.15	≤-47	0.96605	≤20	PASS
			5720	30~1000	-76.30	≤-54	0.02344	≤4	PASS
				1000~26000	-59.77	≤-47	1.05439	≤20	PASS
			5190	30~1000	-77.06	≤-54	0.01968	≤4	PASS
				1000~26000	-59.42	≤-47	1.14288	≤20	PASS
			5230	30~1000	-75.29	≤-54	0.02958	≤4	PASS
				1000~26000	-60.30	≤-47	0.93325	≤20	PASS
			5270	30~1000	-77.06	≤-54	0.01968	≤4	PASS
				1000~26000	-60.59	≤-47	0.87297	≤20	PASS
			5310	30~1000	-76.89	≤-54	0.02046	≤4	PASS
				1000~26000	-60.93	≤-47	0.80724	≤20	PASS
			5510	30~1000	-76.51	≤-54	0.02234	≤4	PASS
				1000~26000	-60.53	≤-47	0.88512	≤20	PASS
			5550	30~1000	-77.14	≤-54	0.01932	≤4	PASS
				1000~26000	-60.53	≤-47	0.88512	≤20	PASS
			5670	30~1000	-75.91	≤-54	0.02564	≤4	PASS
				1000~26000	-56.93	≤-47	2.02768	≤20	PASS
			5710	30~1000	-76.11	≤-54	0.02449	≤4	PASS
				1000~26000	-59.99	≤-47	1.00231	≤20	PASS
	11AC20SI SO	Ant1	5180	30~1000	-76.40	≤-54	0.02291	≤4	PASS
				1000~26000	-60.21	≤-47	0.95280	≤20	PASS
			5200	30~1000	-77.09	≤-54	0.01954	≤4	PASS
				1000~26000	-60.49	≤-47	0.89331	≤20	PASS
			5220	30~1000	-76.39	≤-54	0.02296	≤4	PASS
				1000~26000	-60.44	≤-47	0.90365	≤20	PASS
			5240	30~1000	-76.74	≤-54	0.02118	≤4	PASS
				1000~26000	-60.60	≤-47	0.87096	≤20	PASS
			5260	30~1000	-76.84	≤-54	0.02070	≤4	PASS
				1000~26000	-60.54	≤-47	0.88308	≤20	PASS
			5280	30~1000	-76.35	≤-54	0.02317	≤4	PASS
				1000~26000	-60.36	≤-47	0.92045	≤20	PASS
			5300	30~1000	-76.91	≤-54	0.02037	≤4	PASS
				1000~26000	-60.34	≤-47	0.92470	≤20	PASS
			5320	30~1000	-76.46	≤-54	0.02259	≤4	PASS
				1000~26000	-60.54	≤-47	0.88308	≤20	PASS
			5500	30~1000	-76.90	≤-54	0.02042	≤4	PASS
				1000~26000	-60.36	≤-47	0.92045	≤20	PASS
			5580	30~1000	-76.65	≤-54	0.02163	≤4	PASS
				1000~26000	-59.81	≤-47	1.04472	≤20	PASS
			5600	30~1000	-76.45	≤-54	0.02265	≤4	PASS
				1000~26000	-60.13	≤-47	0.97051	≤20	PASS
			5700	30~1000	-76.67	≤-54	0.02153	≤4	PASS
				1000~26000	-60.38	≤-47	0.91622	≤20	PASS
			5720	30~1000	-77.03	≤-54	0.01982	≤4	PASS



	11AC40SI SO	Ant1		1000~26000	-60.38	≤-47	0.91622	≤20	PASS
			5190	30~1000	-76.96	≤-54	0.02014	≤4	PASS
				1000~26000	-60.47	≤-47	0.89743	≤20	PASS
			5230	30~1000	-76.72	≤-54	0.02128	≤4	PASS
				1000~26000	-60.70	≤-47	0.85114	≤20	PASS
			5270	30~1000	-76.71	≤-54	0.02133	≤4	PASS
				1000~26000	-60.20	≤-47	0.95499	≤20	PASS
			5310	30~1000	-76.87	≤-54	0.02056	≤4	PASS
				1000~26000	-59.91	≤-47	1.02094	≤20	PASS
			5510	30~1000	-76.02	≤-54	0.02500	≤4	PASS
				1000~26000	-59.96	≤-47	1.00925	≤20	PASS
			5550	30~1000	-75.90	≤-54	0.02570	≤4	PASS
				1000~26000	-60.12	≤-47	0.97275	≤20	PASS
			5670	30~1000	-76.31	≤-54	0.02339	≤4	PASS
				1000~26000	-59.90	≤-47	1.02329	≤20	PASS
			5710	30~1000	-76.43	≤-54	0.02275	≤4	PASS
				1000~26000	-60.42	≤-47	0.90782	≤20	PASS
	11AC80SI SO	Ant1	5210	30~1000	-76.57	≤-54	0.02203	≤4	PASS
				1000~26000	-60.61	≤-47	0.86896	≤20	PASS
			5290	30~1000	-76.69	≤-54	0.02143	≤4	PASS
				1000~26000	-60.42	≤-47	0.90782	≤20	PASS
			5530	30~1000	-76.62	≤-54	0.02178	≤4	PASS
				1000~26000	-60.27	≤-47	0.93972	≤20	PASS
			5610	30~1000	-76.15	≤-54	0.02427	≤4	PASS
				1000~26000	-60.53	≤-47	0.88512	≤20	PASS
	11AX20SIS O	Ant1	5690	30~1000	-76.31	≤-54	0.02339	≤4	PASS
				1000~26000	-59.90	≤-47	1.02329	≤20	PASS
			5180	30~1000	-76.74	≤-54	0.02118	≤4	PASS
				1000~26000	-60.84	≤-47	0.82414	≤20	PASS
			5200	30~1000	-76.87	≤-54	0.02056	≤4	PASS
				1000~26000	-60.37	≤-47	0.91833	≤20	PASS
			5220	30~1000	-76.52	≤-54	0.02228	≤4	PASS
				1000~26000	-60.77	≤-47	0.83753	≤20	PASS
			5240	30~1000	-76.49	≤-54	0.02244	≤4	PASS
				1000~26000	-60.60	≤-47	0.87096	≤20	PASS
			5260	30~1000	-76.98	≤-54	0.02004	≤4	PASS
				1000~26000	-60.74	≤-47	0.84333	≤20	PASS
			5280	30~1000	-76.38	≤-54	0.02301	≤4	PASS
				1000~26000	-60.07	≤-47	0.98401	≤20	PASS
			5300	30~1000	-76.77	≤-54	0.02104	≤4	PASS
				1000~26000	-60.61	≤-47	0.86896	≤20	PASS
			5320	30~1000	-77.15	≤-54	0.01928	≤4	PASS
				1000~26000	-60.23	≤-47	0.94842	≤20	PASS
			5500	30~1000	-76.46	≤-54	0.02259	≤4	PASS
				1000~26000	-60.47	≤-47	0.89743	≤20	PASS



NTHV	11AX40SIS O	Ant1	5580	30~1000	-75.61	≤-54	0.02748	≤4	PASS
				1000~26000	-60.31	≤-47	0.93111	≤20	PASS
			5600	30~1000	-76.70	≤-54	0.02138	≤4	PASS
				1000~26000	-59.91	≤-47	1.02094	≤20	PASS
			5700	30~1000	-76.49	≤-54	0.02244	≤4	PASS
				1000~26000	-60.40	≤-47	0.91201	≤20	PASS
			5720	30~1000	-76.16	≤-54	0.02421	≤4	PASS
				1000~26000	-60.19	≤-47	0.95719	≤20	PASS
	11AX80SIS O	Ant1	5190	30~1000	-76.75	≤-54	0.02113	≤4	PASS
				1000~26000	-60.07	≤-47	0.98401	≤20	PASS
			5230	30~1000	-76.02	≤-54	0.02500	≤4	PASS
				1000~26000	-60.56	≤-47	0.87902	≤20	PASS
			5270	30~1000	-77.37	≤-54	0.01832	≤4	PASS
				1000~26000	-59.85	≤-47	1.03514	≤20	PASS
			5310	30~1000	-76.35	≤-54	0.02317	≤4	PASS
				1000~26000	-60.70	≤-47	0.85114	≤20	PASS
			5510	30~1000	-76.29	≤-54	0.02350	≤4	PASS
				1000~26000	-60.28	≤-47	0.93756	≤20	PASS
			5550	30~1000	-76.53	≤-54	0.02223	≤4	PASS
				1000~26000	-59.63	≤-47	1.08893	≤20	PASS
	11A	Ant1	5210	30~1000	-76.67	≤-54	0.02153	≤4	PASS
				1000~26000	-60.09	≤-47	0.97949	≤20	PASS
			5290	30~1000	-76.92	≤-54	0.02032	≤4	PASS
				1000~26000	-60.77	≤-47	0.83753	≤20	PASS
			5530	30~1000	-75.49	≤-54	0.02825	≤4	PASS
				1000~26000	-60.42	≤-47	0.90782	≤20	PASS
			5610	30~1000	-76.70	≤-54	0.02138	≤4	PASS
				1000~26000	-60.24	≤-47	0.94624	≤20	PASS
			5690	30~1000	-76.18	≤-54	0.02410	≤4	PASS
				1000~26000	-59.75	≤-47	1.05925	≤20	PASS
	11A	Ant1	5180	30~1000	-76.83	≤-54	0.02075	≤4	PASS
				1000~26000	-59.77	≤-47	1.05439	≤20	PASS
			5200	30~1000	-77.11	≤-54	0.01945	≤4	PASS
				1000~26000	-60.76	≤-47	0.83946	≤20	PASS
			5220	30~1000	-76.99	≤-54	0.02000	≤4	PASS
				1000~26000	-60.87	≤-47	0.81846	≤20	PASS
			5240	30~1000	-76.36	≤-54	0.02312	≤4	PASS
				1000~26000	-60.58	≤-47	0.87498	≤20	PASS
	11A	Ant1	5260	30~1000	-77.05	≤-54	0.01972	≤4	PASS
				1000~26000	-60.25	≤-47	0.94406	≤20	PASS
	11A	Ant1	5280	30~1000	-76.61	≤-54	0.02183	≤4	PASS
				1000~26000	-60.25	≤-47	0.94406	≤20	PASS



				1000~26000	-57.76	≤-47	1.67494	≤20	PASS
			5300	30~1000	-76.94	≤-54	0.02023	≤4	PASS
				1000~26000	-60.43	≤-47	0.90573	≤20	PASS
			5320	30~1000	-75.53	≤-54	0.02799	≤4	PASS
				1000~26000	-60.46	≤-47	0.89950	≤20	PASS
			5500	30~1000	-77.03	≤-54	0.01982	≤4	PASS
				1000~26000	-60.44	≤-47	0.90365	≤20	PASS
			5580	30~1000	-76.39	≤-54	0.02296	≤4	PASS
				1000~26000	-60.02	≤-47	0.99541	≤20	PASS
			5600	30~1000	-76.26	≤-54	0.02366	≤4	PASS
				1000~26000	-54.14	≤-47	3.85478	≤20	PASS
			5700	30~1000	-76.24	≤-54	0.02377	≤4	PASS
				1000~26000	-60.10	≤-47	0.97724	≤20	PASS
			5720	30~1000	-75.66	≤-54	0.02716	≤4	PASS
				1000~26000	-59.56	≤-47	1.10662	≤20	PASS
	11N20SIS O	Ant1	5180	30~1000	-76.40	≤-54	0.02291	≤4	PASS
				1000~26000	-59.53	≤-47	1.11429	≤20	PASS
			5200	30~1000	-77.15	≤-54	0.01928	≤4	PASS
				1000~26000	-60.55	≤-47	0.88105	≤20	PASS
			5220	30~1000	-76.76	≤-54	0.02109	≤4	PASS
				1000~26000	-60.82	≤-47	0.82794	≤20	PASS
			5240	30~1000	-76.62	≤-54	0.02178	≤4	PASS
				1000~26000	-60.46	≤-47	0.89950	≤20	PASS
			5260	30~1000	-77.09	≤-54	0.01954	≤4	PASS
				1000~26000	-60.51	≤-47	0.88920	≤20	PASS
			5280	30~1000	-76.86	≤-54	0.02061	≤4	PASS
				1000~26000	-59.89	≤-47	1.02565	≤20	PASS
			5300	30~1000	-76.42	≤-54	0.02280	≤4	PASS
				1000~26000	-60.75	≤-47	0.84140	≤20	PASS
			5320	30~1000	-76.87	≤-54	0.02056	≤4	PASS
				1000~26000	-60.58	≤-47	0.87498	≤20	PASS
			5500	30~1000	-76.13	≤-54	0.02438	≤4	PASS
				1000~26000	-60.41	≤-47	0.90991	≤20	PASS
			5580	30~1000	-76.69	≤-54	0.02143	≤4	PASS
				1000~26000	-60.37	≤-47	0.91833	≤20	PASS
			5600	30~1000	-71.55	≤-54	0.06998	≤4	PASS
				1000~26000	-59.74	≤-47	1.06170	≤20	PASS
			5700	30~1000	-76.41	≤-54	0.02286	≤4	PASS
				1000~26000	-59.85	≤-47	1.03514	≤20	PASS
			5720	30~1000	-75.66	≤-54	0.02716	≤4	PASS
				1000~26000	-60.39	≤-47	0.91411	≤20	PASS
	11N40SIS O	Ant1	5190	30~1000	-76.59	≤-54	0.02193	≤4	PASS
				1000~26000	-60.76	≤-47	0.83946	≤20	PASS
			5230	30~1000	-75.23	≤-54	0.02999	≤4	PASS
				1000~26000	-60.63	≤-47	0.86497	≤20	PASS



			5270	30~1000	-76.59	≤-54	0.02193	≤4	PASS
				1000~26000	-60.69	≤-47	0.85310	≤20	PASS
			5310	30~1000	-76.59	≤-54	0.02193	≤4	PASS
				1000~26000	-60.68	≤-47	0.85507	≤20	PASS
			5510	30~1000	-77.16	≤-54	0.01923	≤4	PASS
				1000~26000	-60.80	≤-47	0.83176	≤20	PASS
			5550	30~1000	-76.47	≤-54	0.02254	≤4	PASS
				1000~26000	-60.23	≤-47	0.94842	≤20	PASS
			5670	30~1000	-75.59	≤-54	0.02761	≤4	PASS
				1000~26000	-58.65	≤-47	1.36458	≤20	PASS
			5710	30~1000	-75.76	≤-54	0.02655	≤4	PASS
				1000~26000	-59.81	≤-47	1.04472	≤20	PASS
	11AC20SI SO	Ant1	5180	30~1000	-75.73	≤-54	0.02673	≤4	PASS
				1000~26000	-60.79	≤-47	0.83368	≤20	PASS
			5200	30~1000	-76.52	≤-54	0.02228	≤4	PASS
				1000~26000	-60.27	≤-47	0.93972	≤20	PASS
			5220	30~1000	-77.13	≤-54	0.01936	≤4	PASS
				1000~26000	-60.67	≤-47	0.85704	≤20	PASS
			5240	30~1000	-77.03	≤-54	0.01982	≤4	PASS
				1000~26000	-60.62	≤-47	0.86696	≤20	PASS
			5260	30~1000	-76.84	≤-54	0.02070	≤4	PASS
				1000~26000	-59.98	≤-47	1.00462	≤20	PASS
			5280	30~1000	-76.72	≤-54	0.02128	≤4	PASS
				1000~26000	-60.42	≤-47	0.90782	≤20	PASS
			5300	30~1000	-77.09	≤-54	0.01954	≤4	PASS
				1000~26000	-60.31	≤-47	0.93111	≤20	PASS
			5320	30~1000	-76.47	≤-54	0.02254	≤4	PASS
				1000~26000	-60.71	≤-47	0.84918	≤20	PASS
			5500	30~1000	-76.67	≤-54	0.02153	≤4	PASS
				1000~26000	-60.25	≤-47	0.94406	≤20	PASS
			5580	30~1000	-76.49	≤-54	0.02244	≤4	PASS
				1000~26000	-60.18	≤-47	0.95940	≤20	PASS
			5600	30~1000	-76.54	≤-54	0.02218	≤4	PASS
				1000~26000	-60.10	≤-47	0.97724	≤20	PASS
			5700	30~1000	-76.06	≤-54	0.02477	≤4	PASS
				1000~26000	-59.77	≤-47	1.05439	≤20	PASS
			5720	30~1000	-76.62	≤-54	0.02178	≤4	PASS
				1000~26000	-60.32	≤-47	0.92897	≤20	PASS
	11AC40SI SO	Ant1	5190	30~1000	-76.60	≤-54	0.02188	≤4	PASS
				1000~26000	-60.03	≤-47	0.99312	≤20	PASS
			5230	30~1000	-76.92	≤-54	0.02032	≤4	PASS
				1000~26000	-60.36	≤-47	0.92045	≤20	PASS
			5270	30~1000	-76.87	≤-54	0.02056	≤4	PASS
				1000~26000	-60.80	≤-47	0.83176	≤20	PASS
			5310	30~1000	-76.81	≤-54	0.02084	≤4	PASS



	11AC80SI SO	Ant1		1000~26000	-60.81	≤ -47	0.82985	≤ 20	PASS
			5510	30~1000	-76.23	≤ -54	0.02382	≤ 4	PASS
				1000~26000	-58.61	≤ -47	1.37721	≤ 20	PASS
			5550	30~1000	-76.59	≤ -54	0.02193	≤ 4	PASS
				1000~26000	-60.52	≤ -47	0.88716	≤ 20	PASS
			5670	30~1000	-75.88	≤ -54	0.02582	≤ 4	PASS
				1000~26000	-60.13	≤ -47	0.97051	≤ 20	PASS
			5710	30~1000	-76.51	≤ -54	0.02234	≤ 4	PASS
				1000~26000	-59.87	≤ -47	1.03039	≤ 20	PASS
			5210	30~1000	-76.73	≤ -54	0.02123	≤ 4	PASS
				1000~26000	-60.63	≤ -47	0.86497	≤ 20	PASS
			5290	30~1000	-56.13	≤ -54	2.43781	≤ 4	PASS
				1000~26000	-60.20	≤ -47	0.95499	≤ 20	PASS
	11AX20SIS O	Ant1	5530	30~1000	-76.75	≤ -54	0.02113	≤ 4	PASS
				1000~26000	-60.39	≤ -47	0.91411	≤ 20	PASS
			5610	30~1000	-76.55	≤ -54	0.02213	≤ 4	PASS
				1000~26000	-59.99	≤ -47	1.00231	≤ 20	PASS
			5690	30~1000	-75.30	≤ -54	0.02951	≤ 4	PASS
				1000~26000	-60.04	≤ -47	0.99083	≤ 20	PASS
			5180	30~1000	-76.84	≤ -54	0.02070	≤ 4	PASS
				1000~26000	-60.30	≤ -47	0.93325	≤ 20	PASS
			5200	30~1000	-77.36	≤ -54	0.01837	≤ 4	PASS
				1000~26000	-60.51	≤ -47	0.88920	≤ 20	PASS
			5220	30~1000	-76.38	≤ -54	0.02301	≤ 4	PASS
				1000~26000	-60.99	≤ -47	0.79616	≤ 20	PASS
			5240	30~1000	-76.92	≤ -54	0.02032	≤ 4	PASS
				1000~26000	-60.58	≤ -47	0.87498	≤ 20	PASS
			5260	30~1000	-76.28	≤ -54	0.02355	≤ 4	PASS
				1000~26000	-60.52	≤ -47	0.88716	≤ 20	PASS
			5280	30~1000	-77.16	≤ -54	0.01923	≤ 4	PASS
				1000~26000	-60.54	≤ -47	0.88308	≤ 20	PASS
			5300	30~1000	-75.92	≤ -54	0.02559	≤ 4	PASS
				1000~26000	-60.96	≤ -47	0.80168	≤ 20	PASS
			5320	30~1000	-76.58	≤ -54	0.02198	≤ 4	PASS
				1000~26000	-60.46	≤ -47	0.89950	≤ 20	PASS
			5500	30~1000	-76.80	≤ -54	0.02089	≤ 4	PASS
				1000~26000	-60.60	≤ -47	0.87096	≤ 20	PASS
			5580	30~1000	-76.79	≤ -54	0.02094	≤ 4	PASS
				1000~26000	-60.25	≤ -47	0.94406	≤ 20	PASS
			5600	30~1000	-76.15	≤ -54	0.02427	≤ 4	PASS
				1000~26000	-60.41	≤ -47	0.90991	≤ 20	PASS
			5700	30~1000	-76.26	≤ -54	0.02366	≤ 4	PASS
				1000~26000	-60.16	≤ -47	0.96383	≤ 20	PASS
			5720	30~1000	-75.91	≤ -54	0.02564	≤ 4	PASS
				1000~26000	-60.10	≤ -47	0.97724	≤ 20	PASS




	11AX40SIS O	Ant1	5190	30~1000	-76.76	≤-54	0.02109	≤4	PASS
				1000~26000	-60.87	≤-47	0.81846	≤20	PASS
			5230	30~1000	-76.73	≤-54	0.02123	≤4	PASS
				1000~26000	-60.23	≤-47	0.94842	≤20	PASS
			5270	30~1000	-76.72	≤-54	0.02128	≤4	PASS
				1000~26000	-60.92	≤-47	0.80910	≤20	PASS
			5310	30~1000	-77.16	≤-54	0.01923	≤4	PASS
				1000~26000	-60.56	≤-47	0.87902	≤20	PASS
			5510	30~1000	-76.94	≤-54	0.02023	≤4	PASS
				1000~26000	-60.04	≤-47	0.99083	≤20	PASS
	11AX80SIS O	Ant1	5550	30~1000	-76.80	≤-54	0.02089	≤4	PASS
				1000~26000	-60.12	≤-47	0.97275	≤20	PASS
			5670	30~1000	-75.82	≤-54	0.02618	≤4	PASS
				1000~26000	-59.95	≤-47	1.01158	≤20	PASS
			5710	30~1000	-75.90	≤-54	0.02570	≤4	PASS
				1000~26000	-59.91	≤-47	1.02094	≤20	PASS
			5210	30~1000	-76.24	≤-54	0.02377	≤4	PASS
				1000~26000	-60.75	≤-47	0.84140	≤20	PASS
			5290	30~1000	-76.54	≤-54	0.02218	≤4	PASS
				1000~26000	-60.63	≤-47	0.86497	≤20	PASS
			5530	30~1000	-76.91	≤-54	0.02037	≤4	PASS
				1000~26000	-60.33	≤-47	0.92683	≤20	PASS
			5610	30~1000	-76.53	≤-54	0.02223	≤4	PASS
				1000~26000	-60.33	≤-47	0.92683	≤20	PASS
			5690	30~1000	-76.56	≤-54	0.02208	≤4	PASS
				1000~26000	-59.97	≤-47	1.00693	≤20	PASS


Remark: Only show the test data of worst condition.




Test Graphs

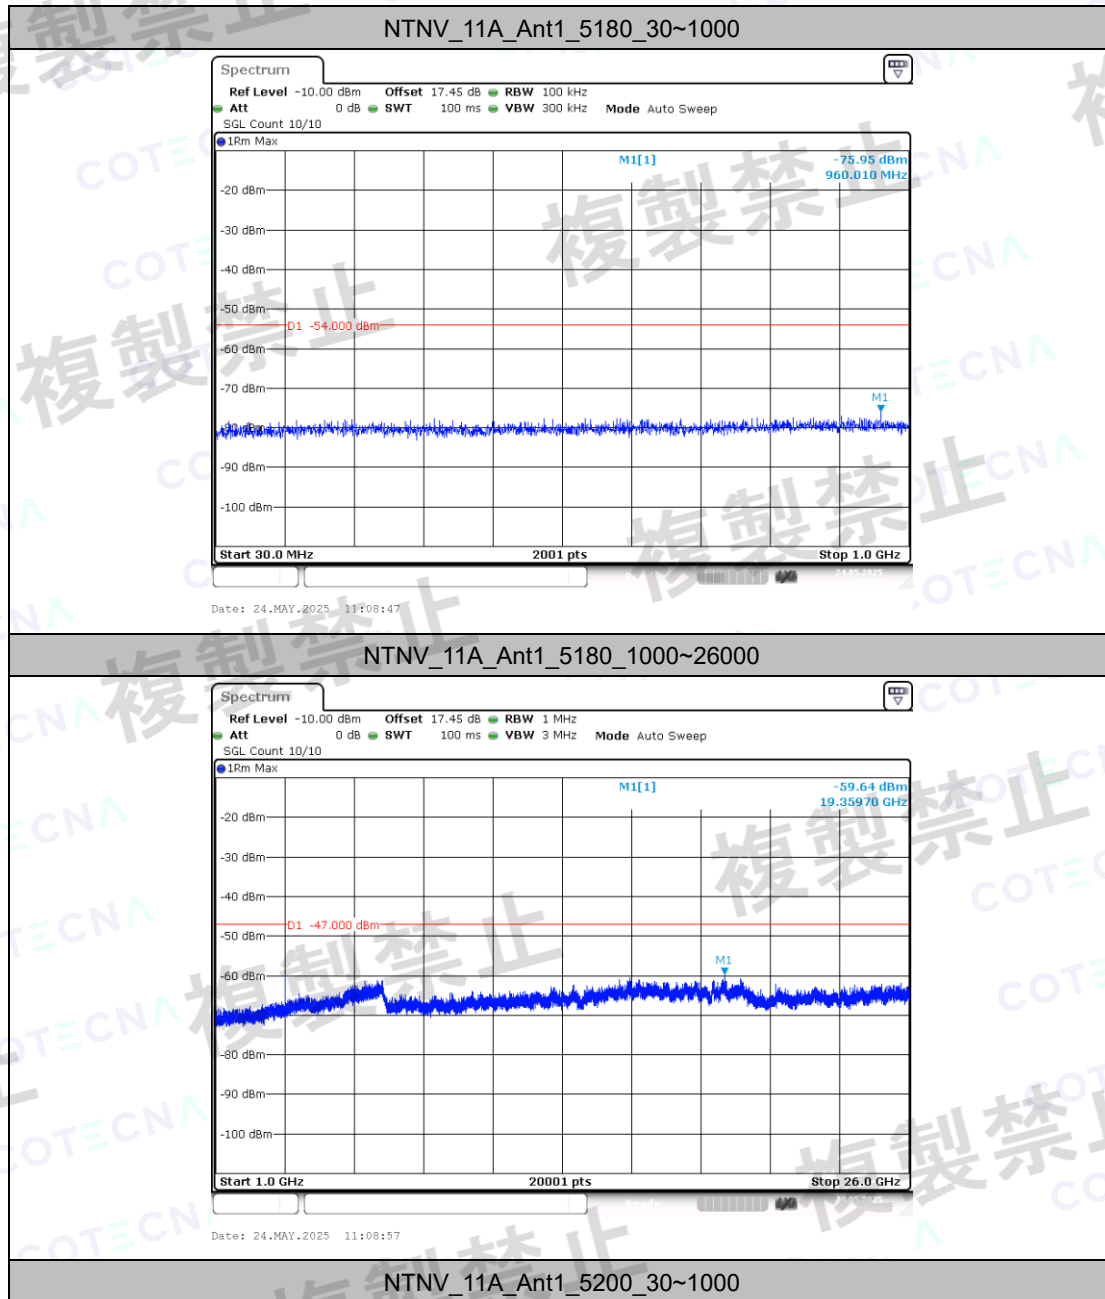




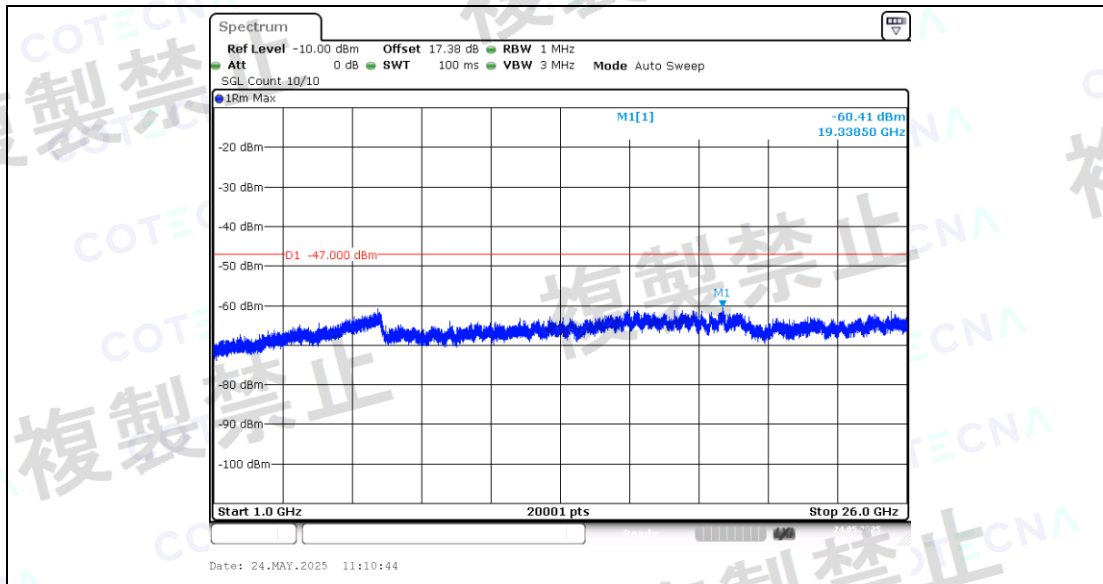

NTVN_11A_Ant1_5240_30~1000

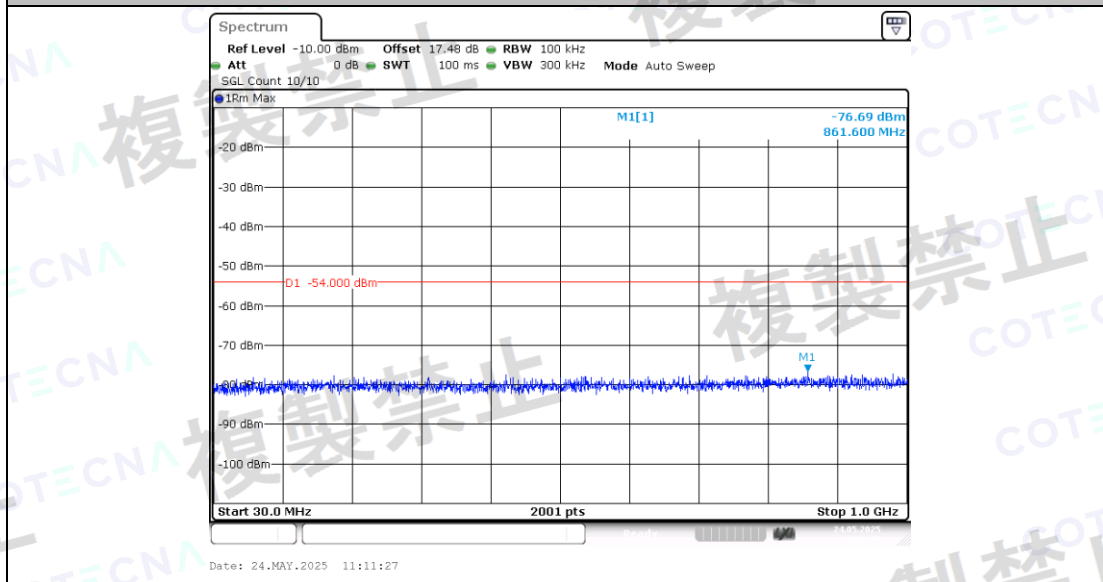



NTVN_11A_Ant1_5240_1000~26000

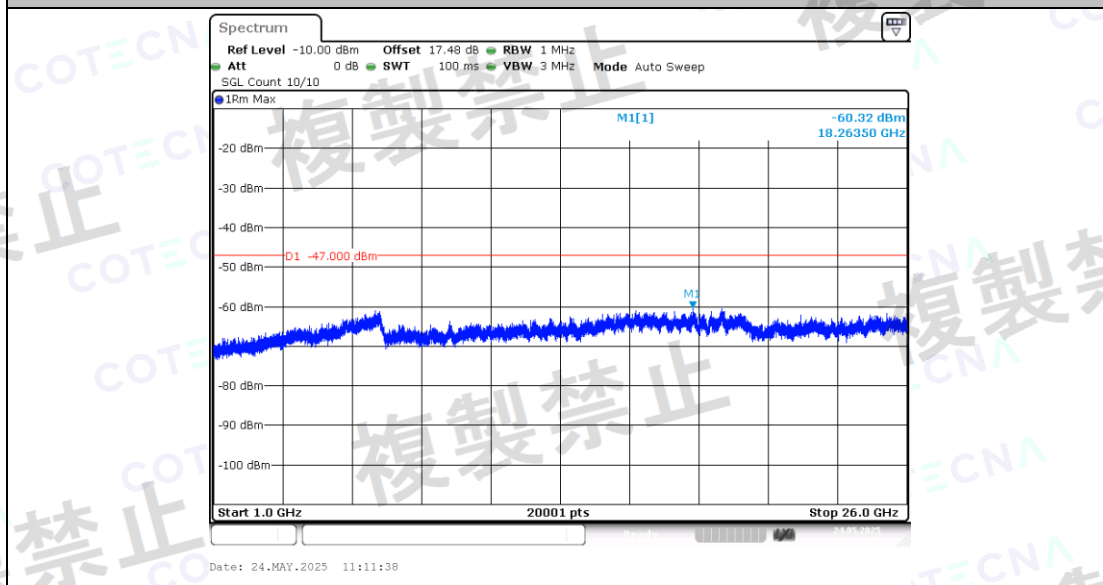


NTVN_11A_Ant1_5260_30~1000



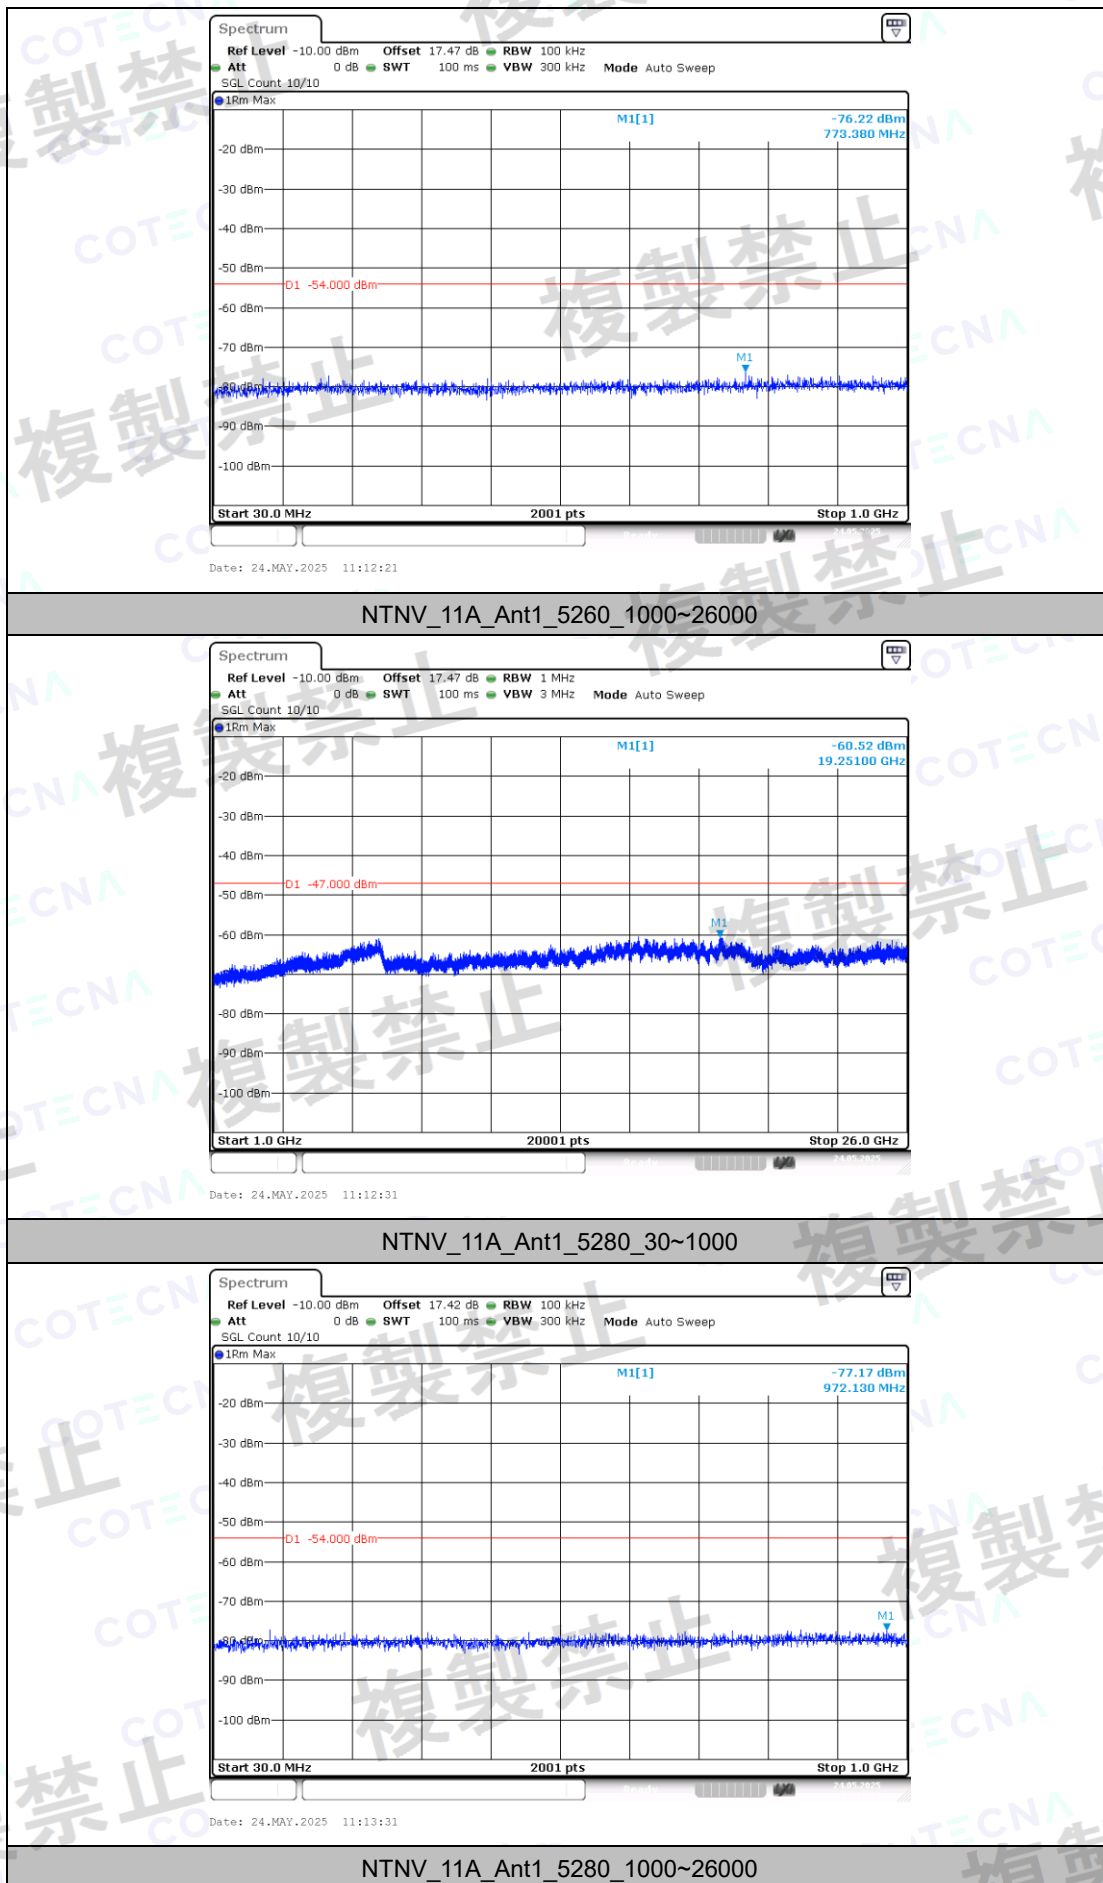


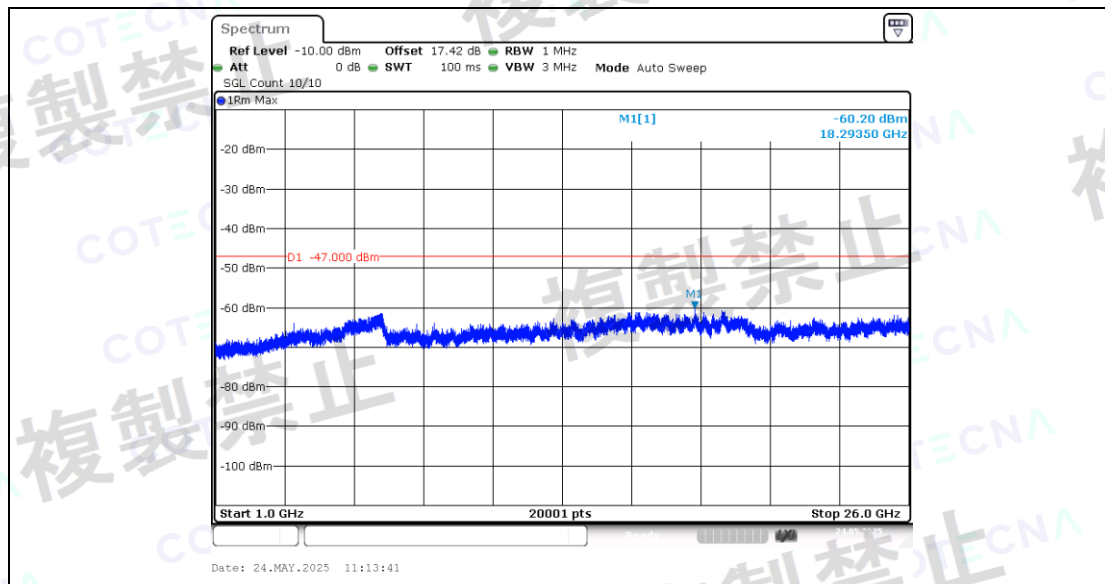

NTVN_11A_Ant1_5300_30~1000

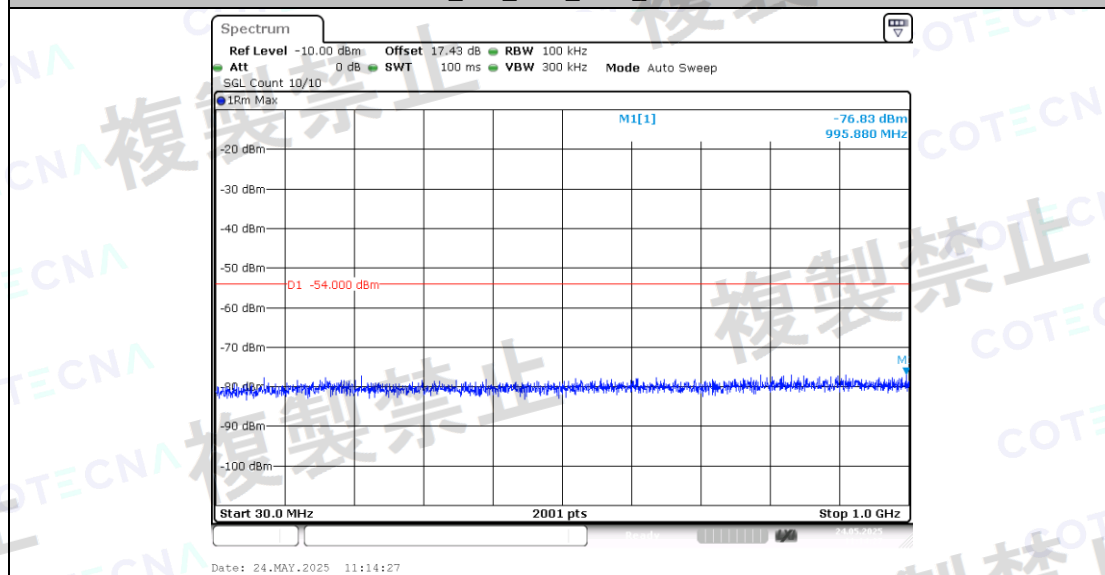



NTNV_11A_Ant1_5300_1000~26000

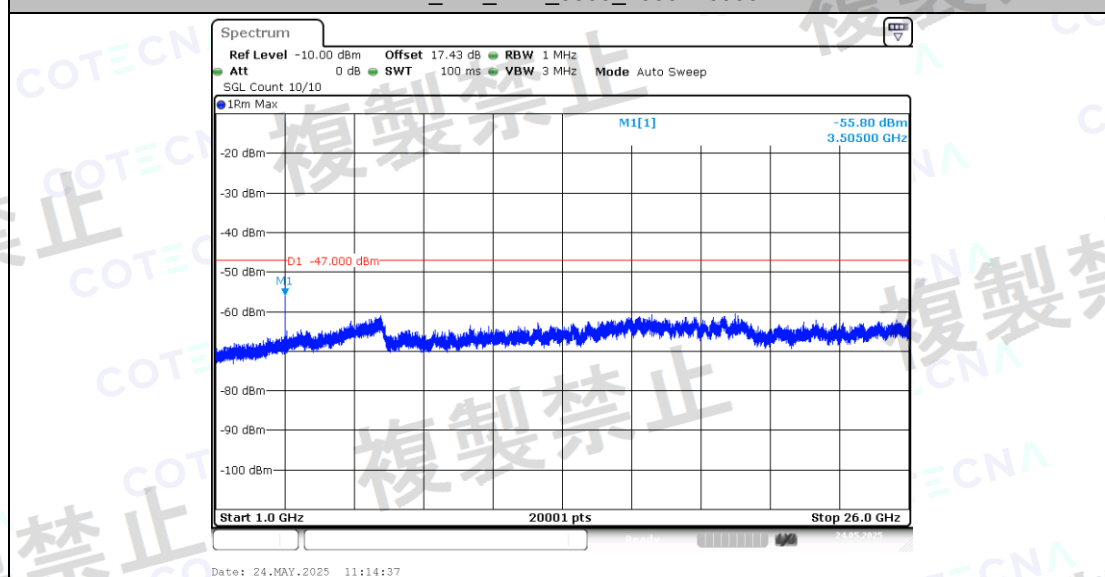


NTNV_11A_Ant1_5320_30~1000



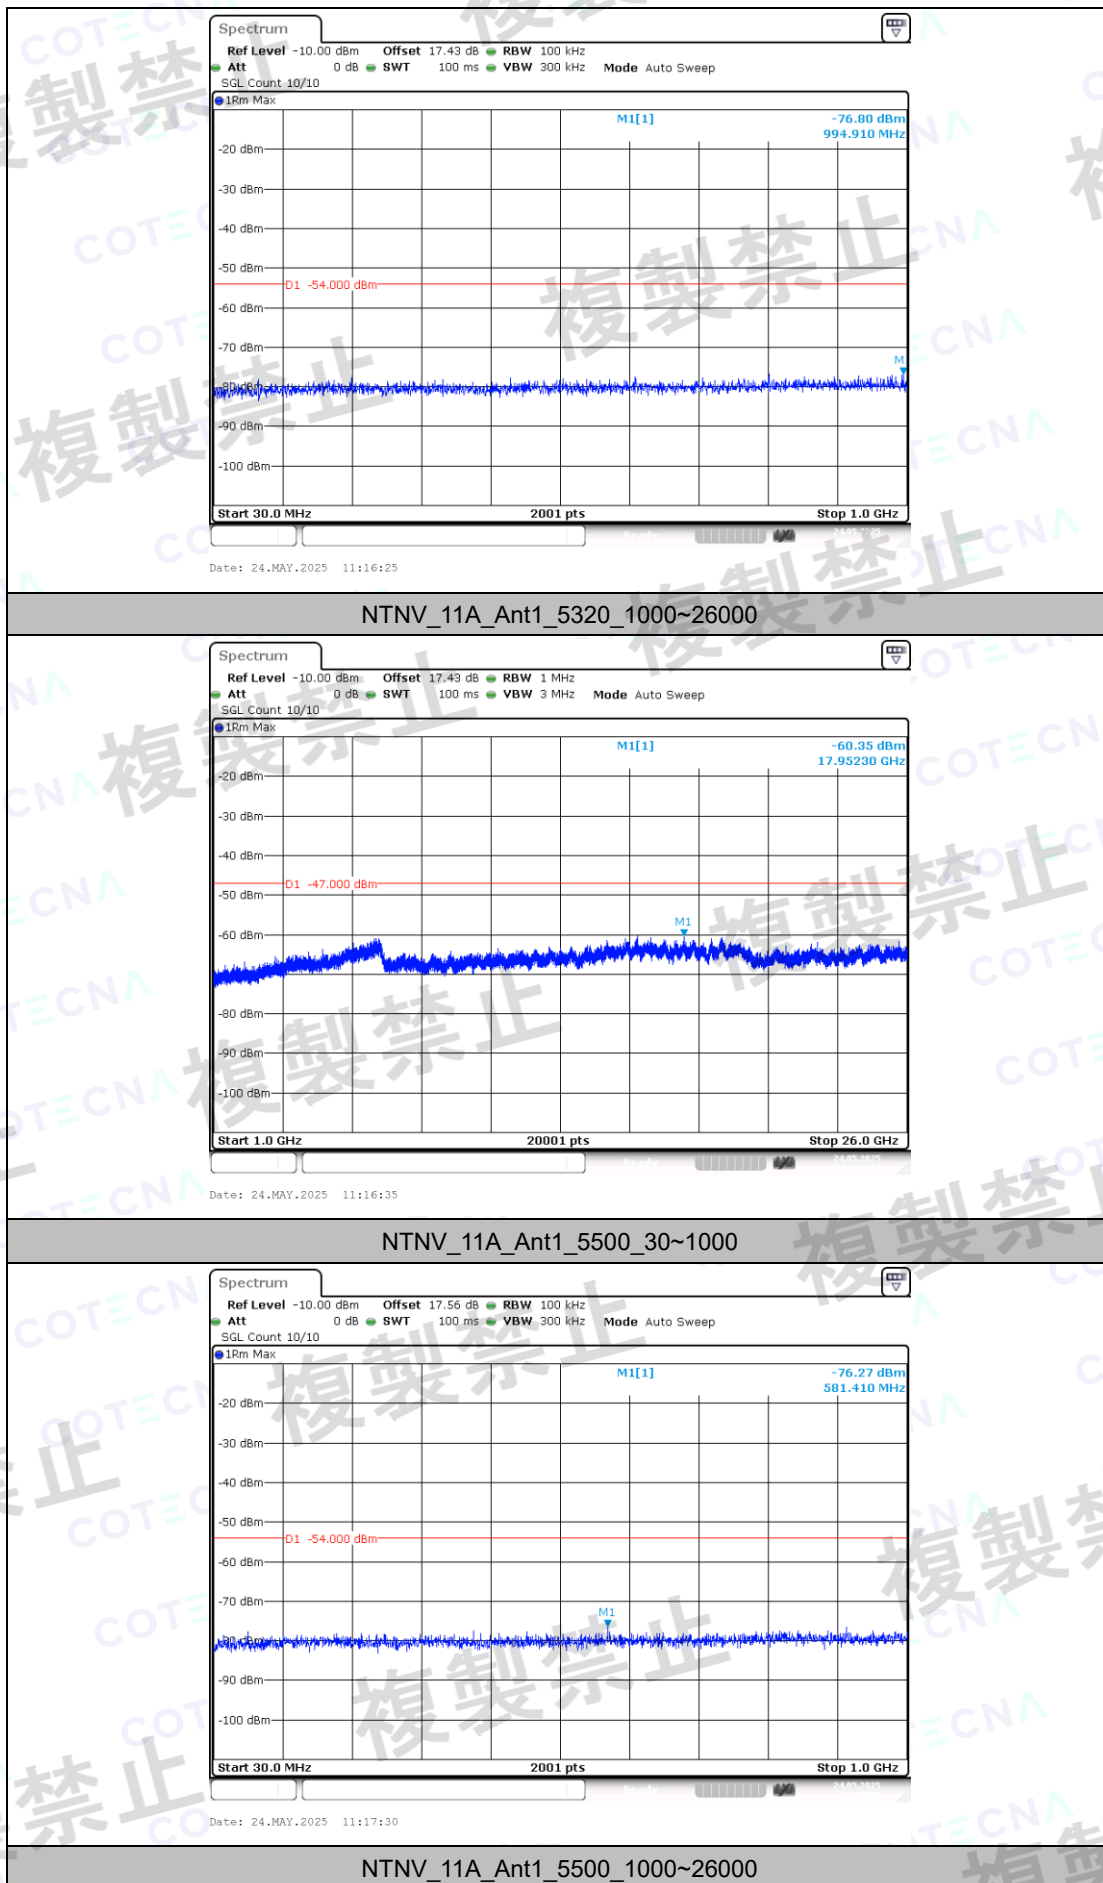


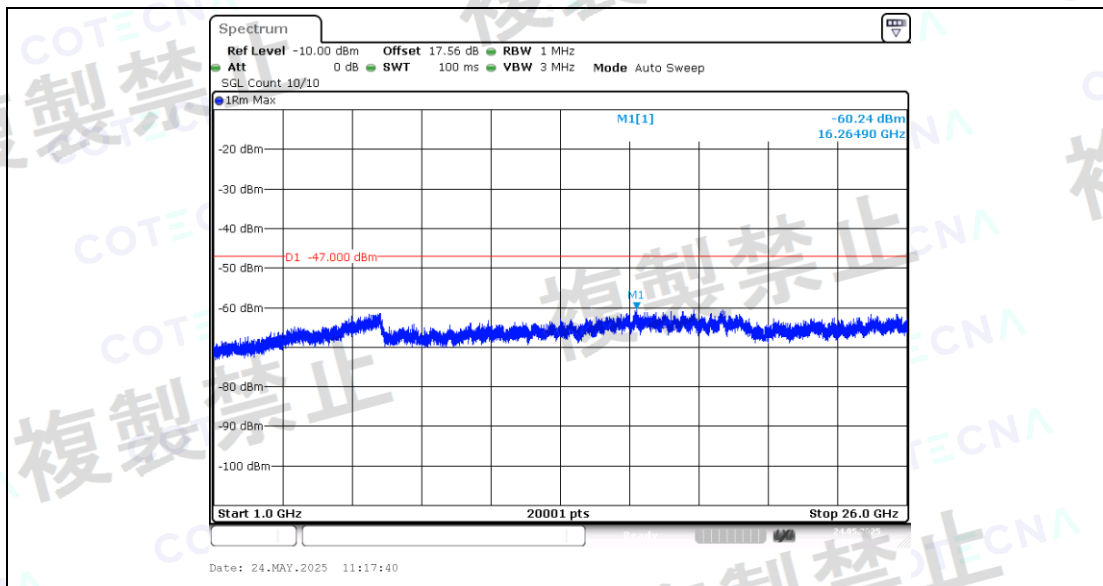

NTVN_11A_Ant1_5580_30~1000

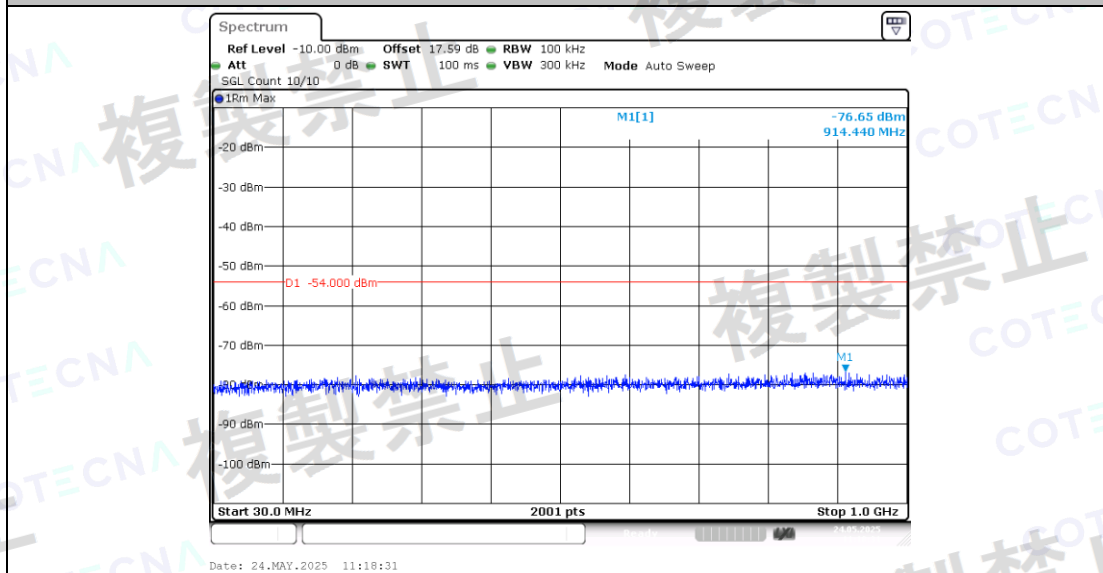



NTVN_11A_Ant1_5580_1000~26000

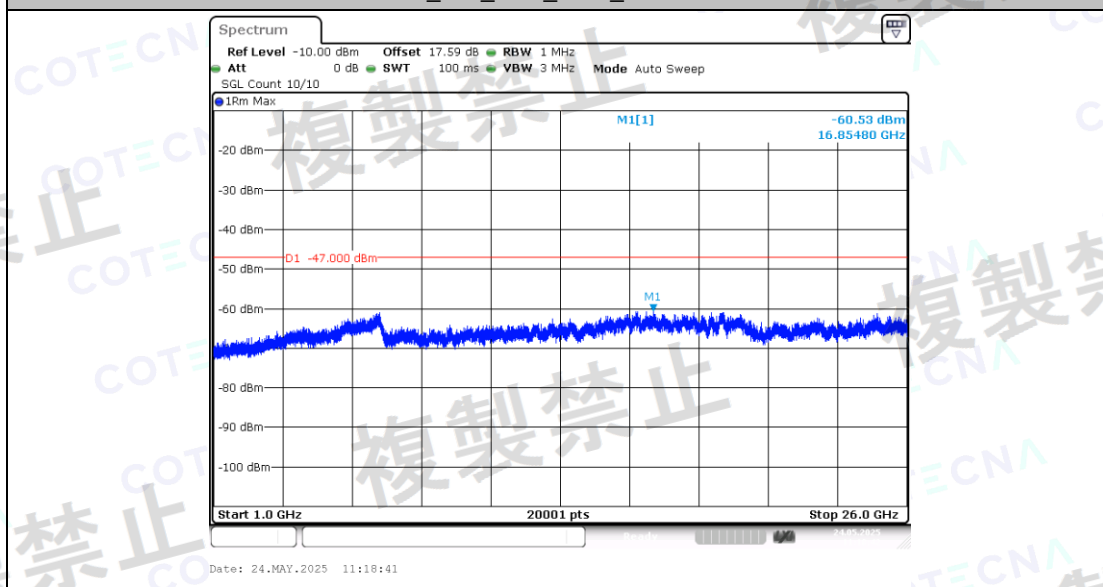


NTVN_11A_Ant1_5600_30~1000



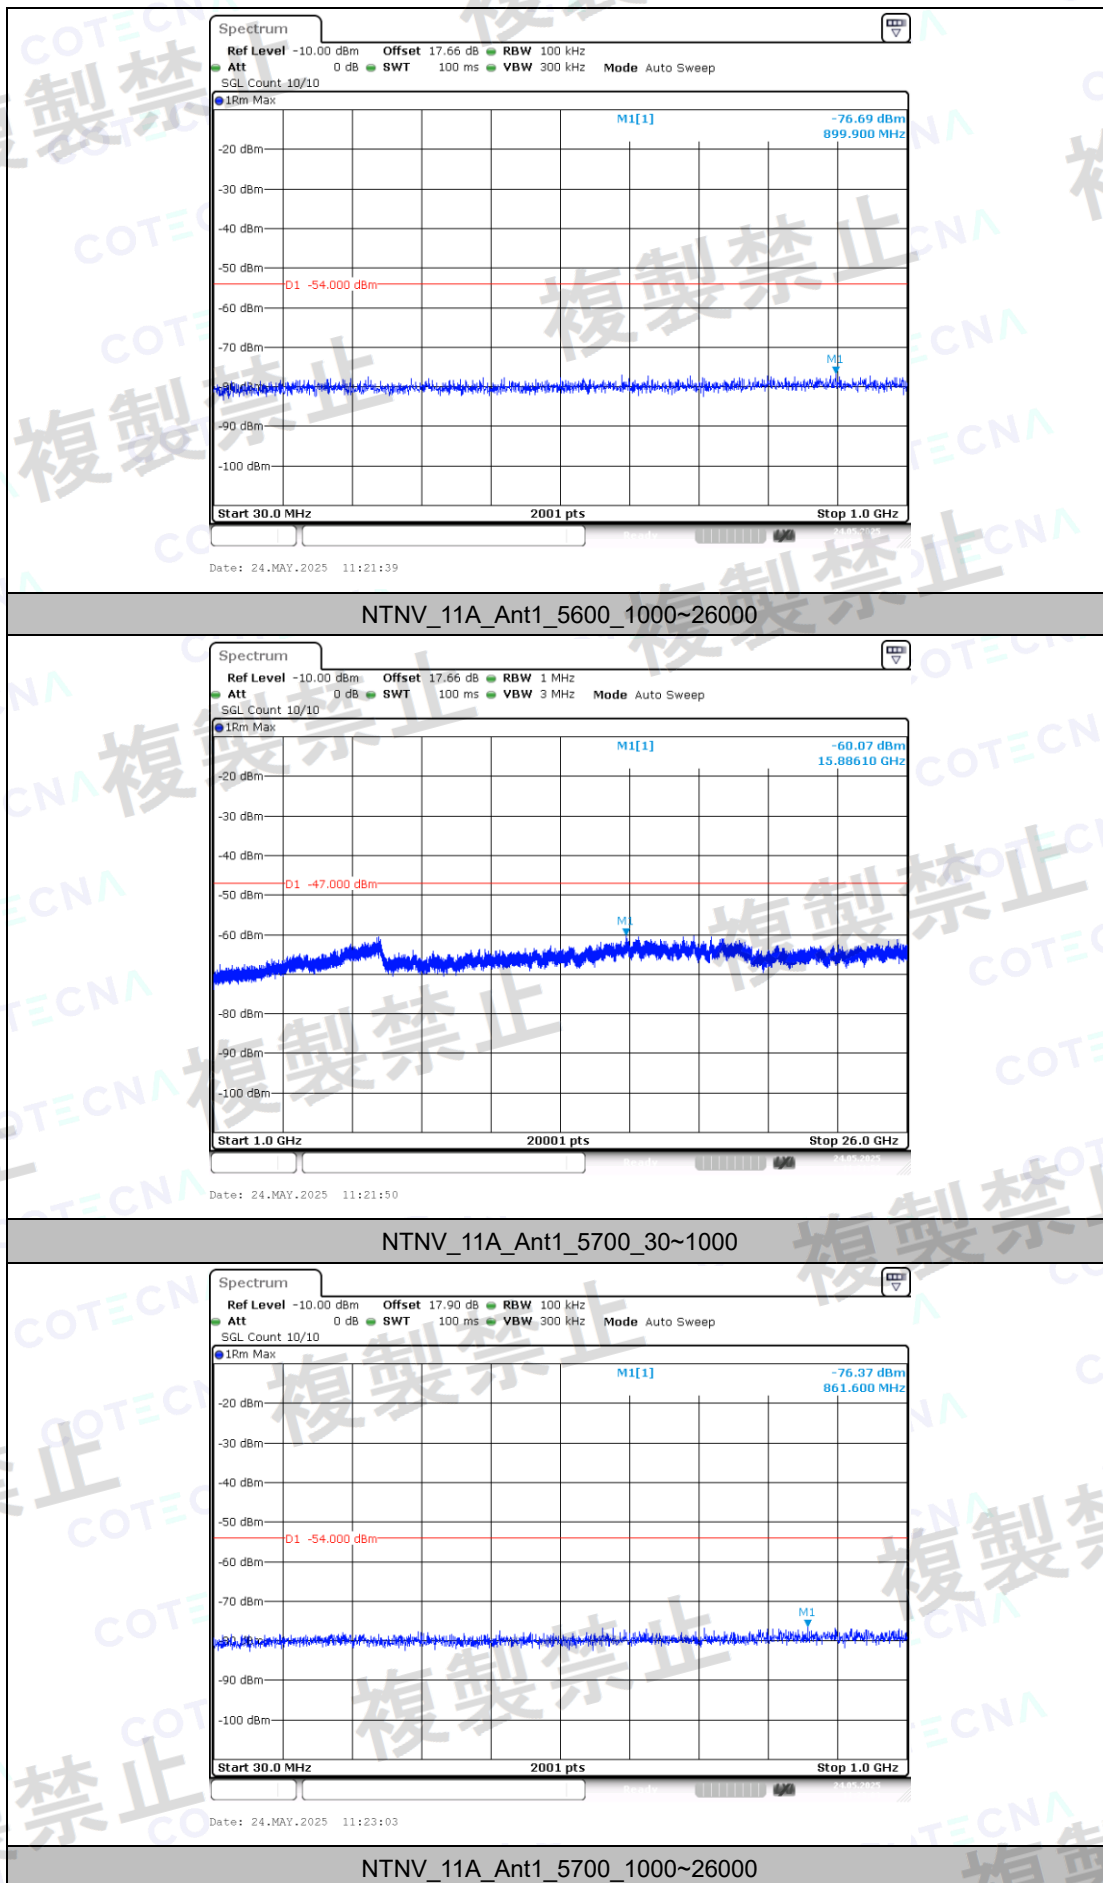


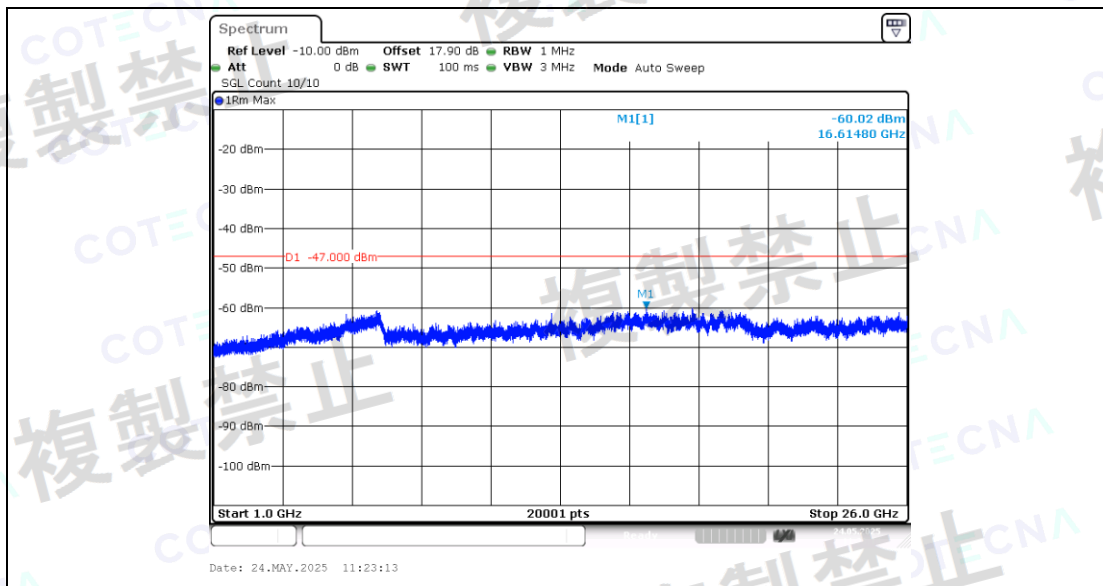

NTVN_11A_Ant1_5720_30~1000

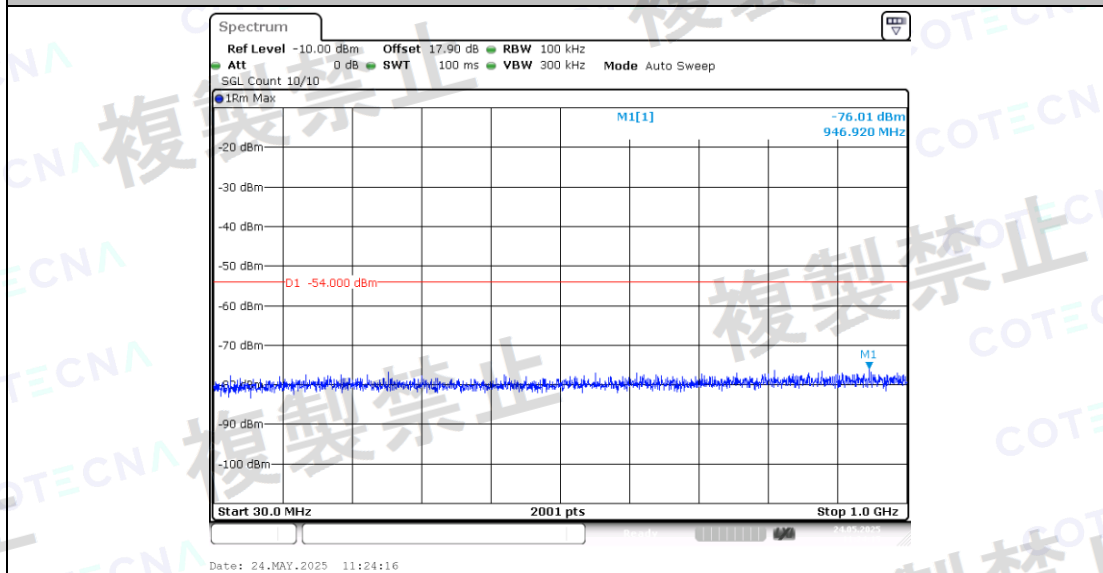


NTNV_11A_Ant1_5720_1000~26000

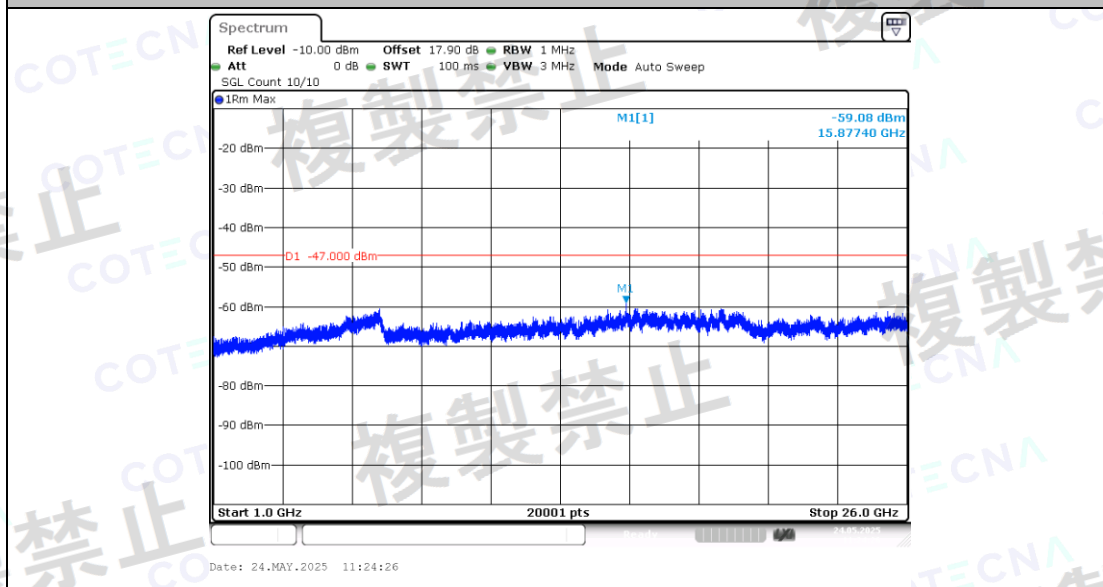


NTNV_11N20SISO_Ant1_5180_30~1000






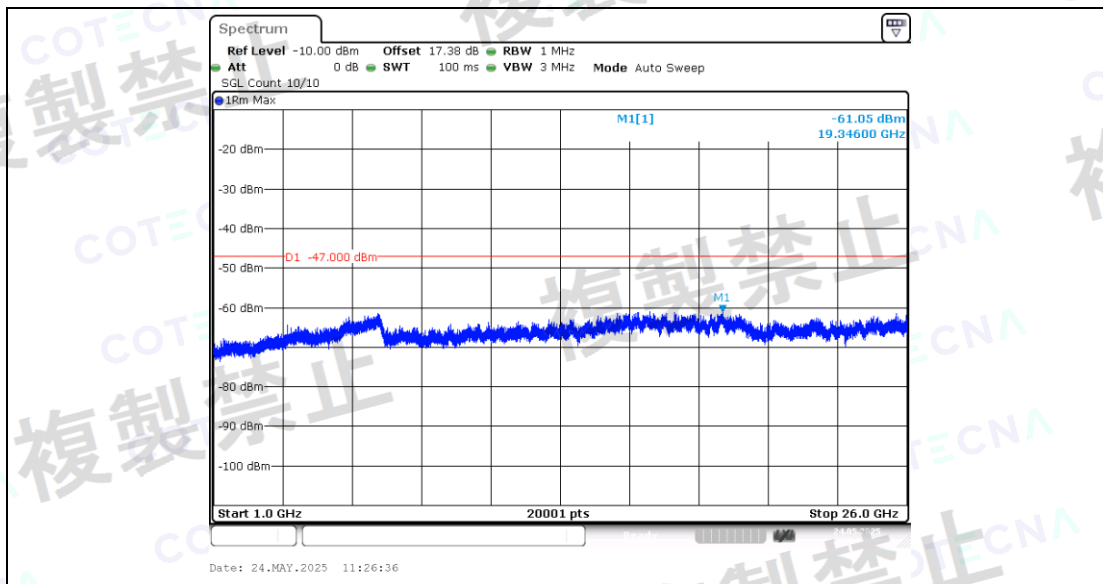

NTNV_11N20SISO_Ant1_5220_30~1000

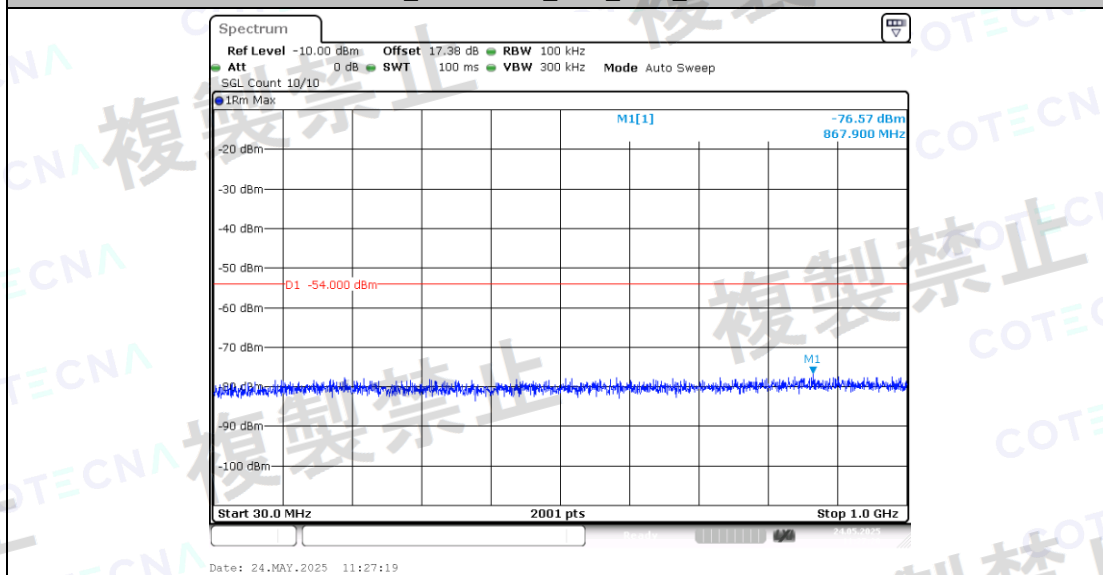


NTNV_11N20SISO_Ant1_5220_1000~26000

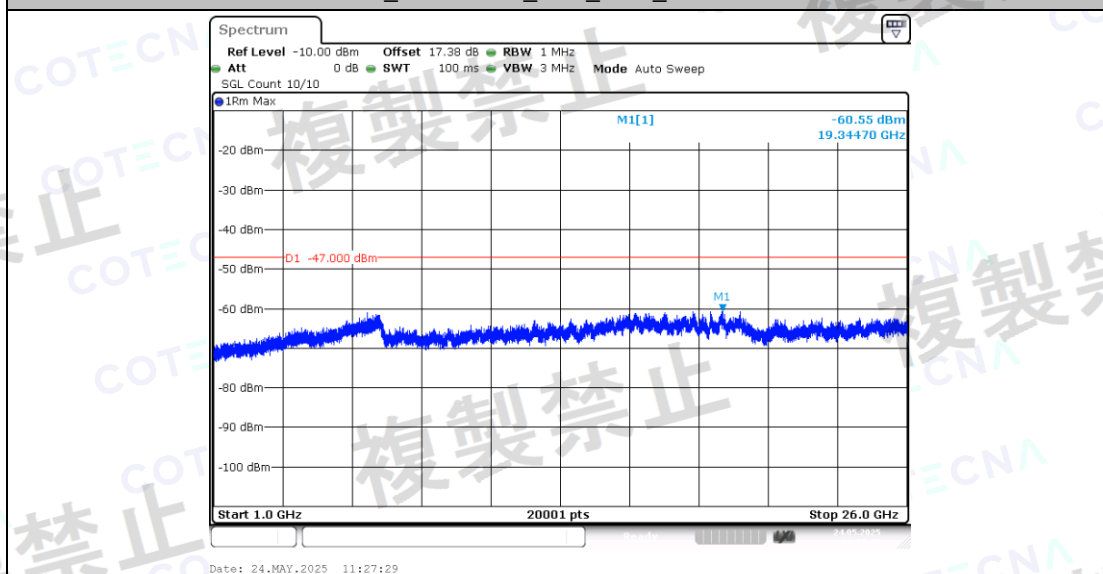


NTNV_11N20SISO_Ant1_5240_30~1000




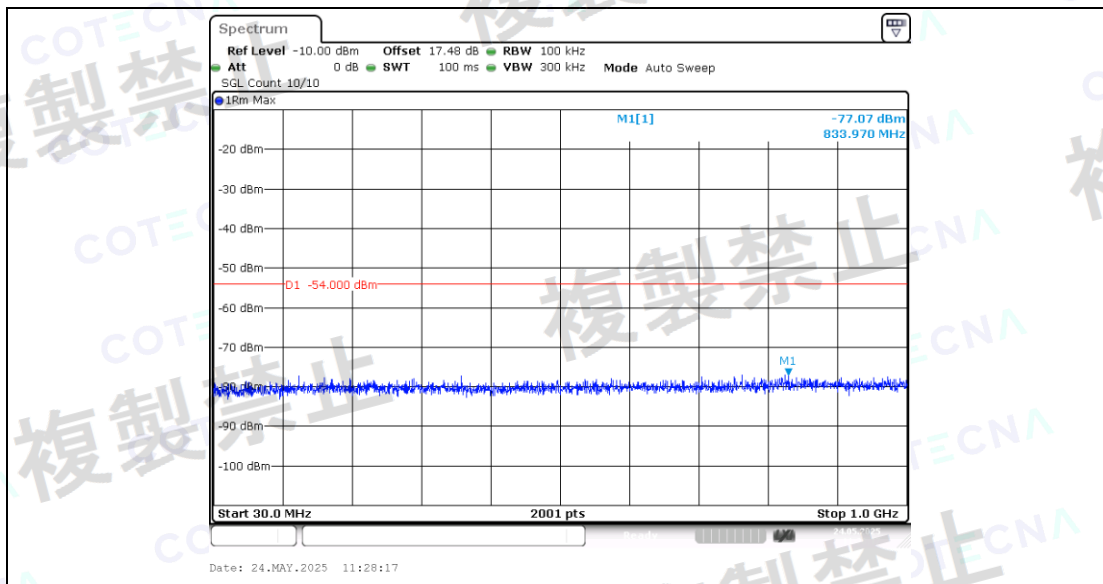

NTNV_11N20SISO_Ant1_5240_1000~26000

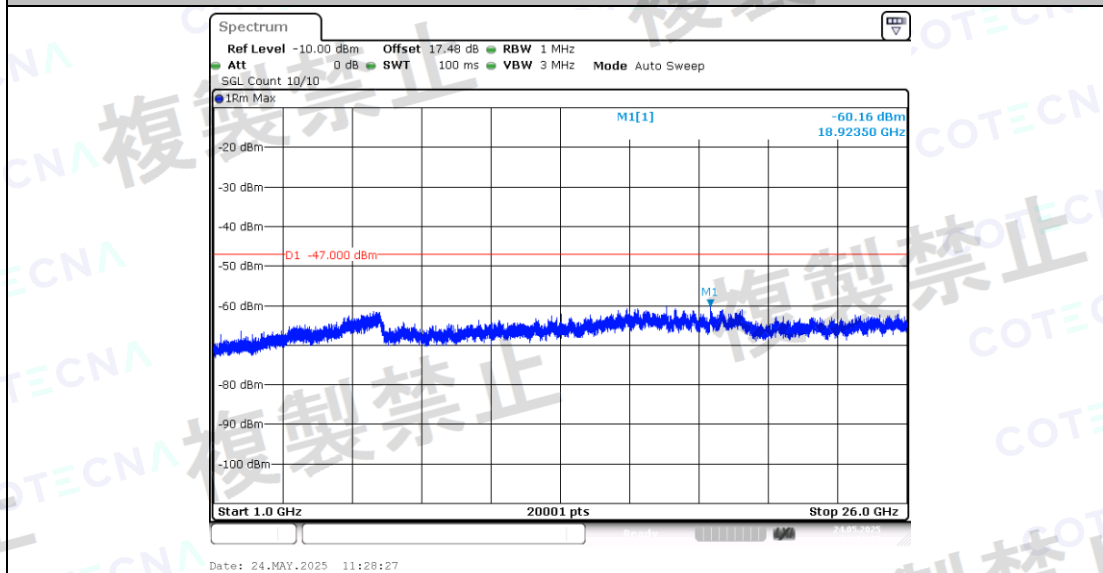


NTNV_11N20SISO_Ant1_5260_30~1000

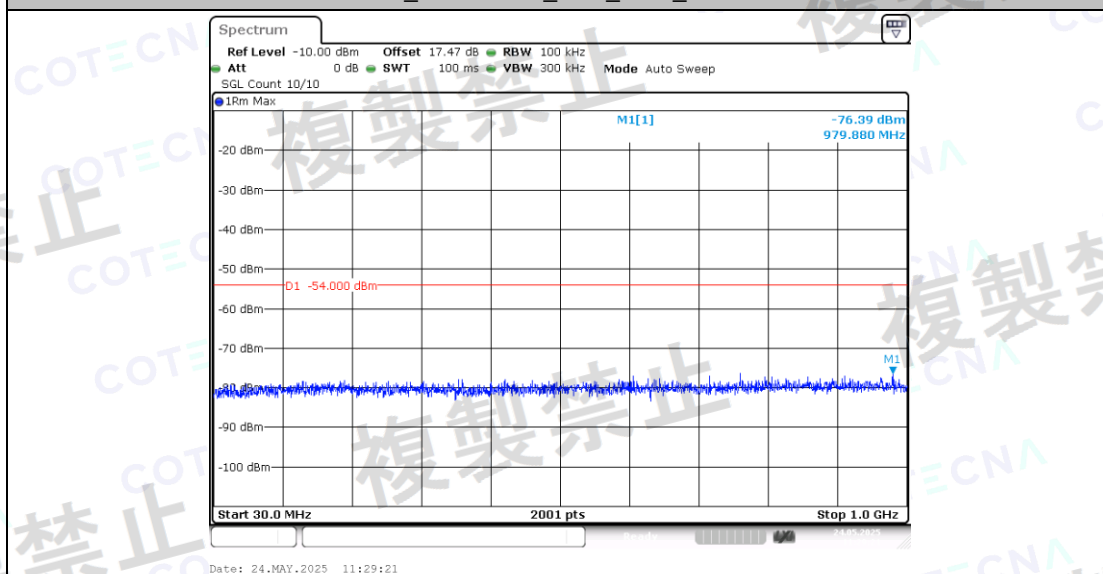


NTNV_11N20SISO_Ant1_5260_1000~26000




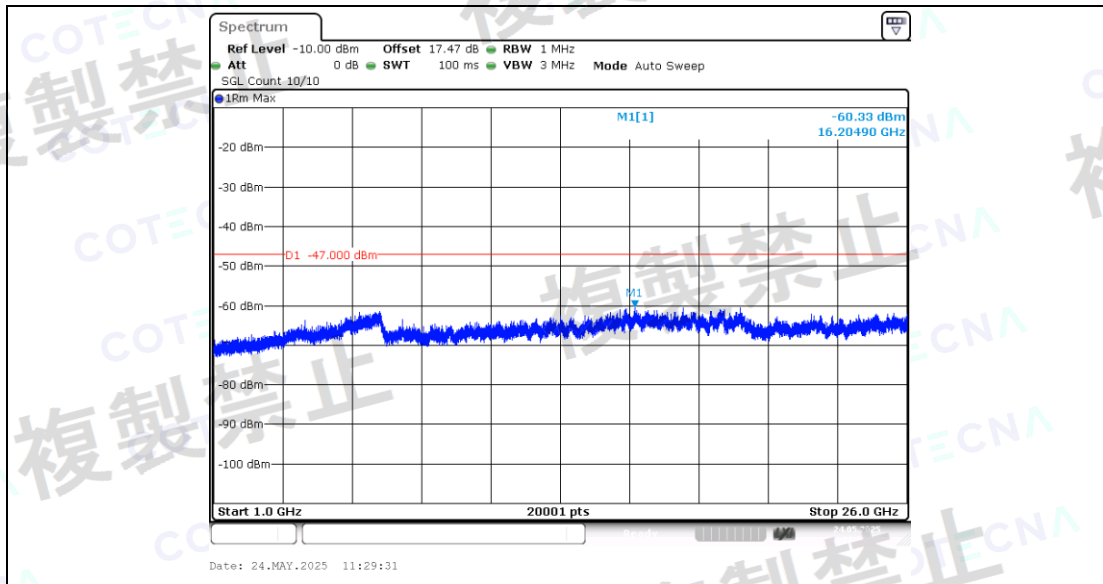

NTNV_11N20SISO_Ant1_5280_30~1000

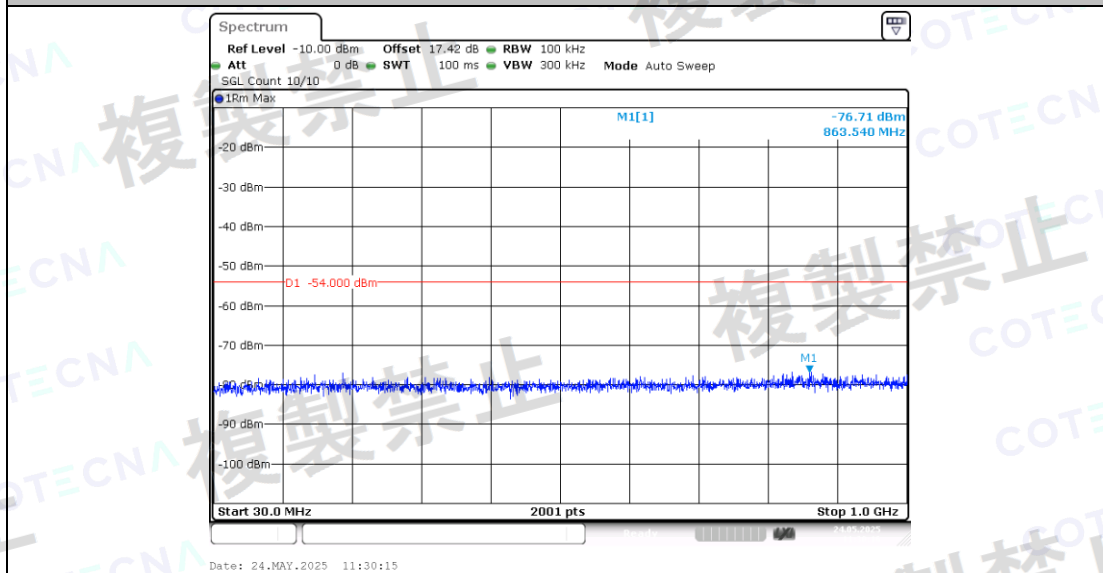


NTNV_11N20SISO_Ant1_5280_1000~26000

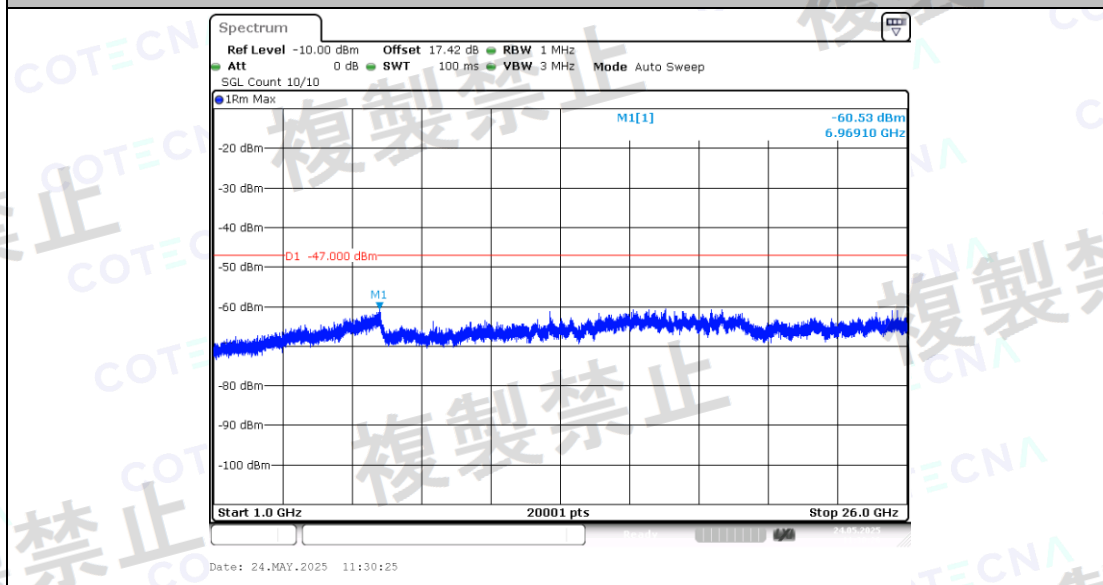


NTNV_11N20SISO_Ant1_5300_30~1000






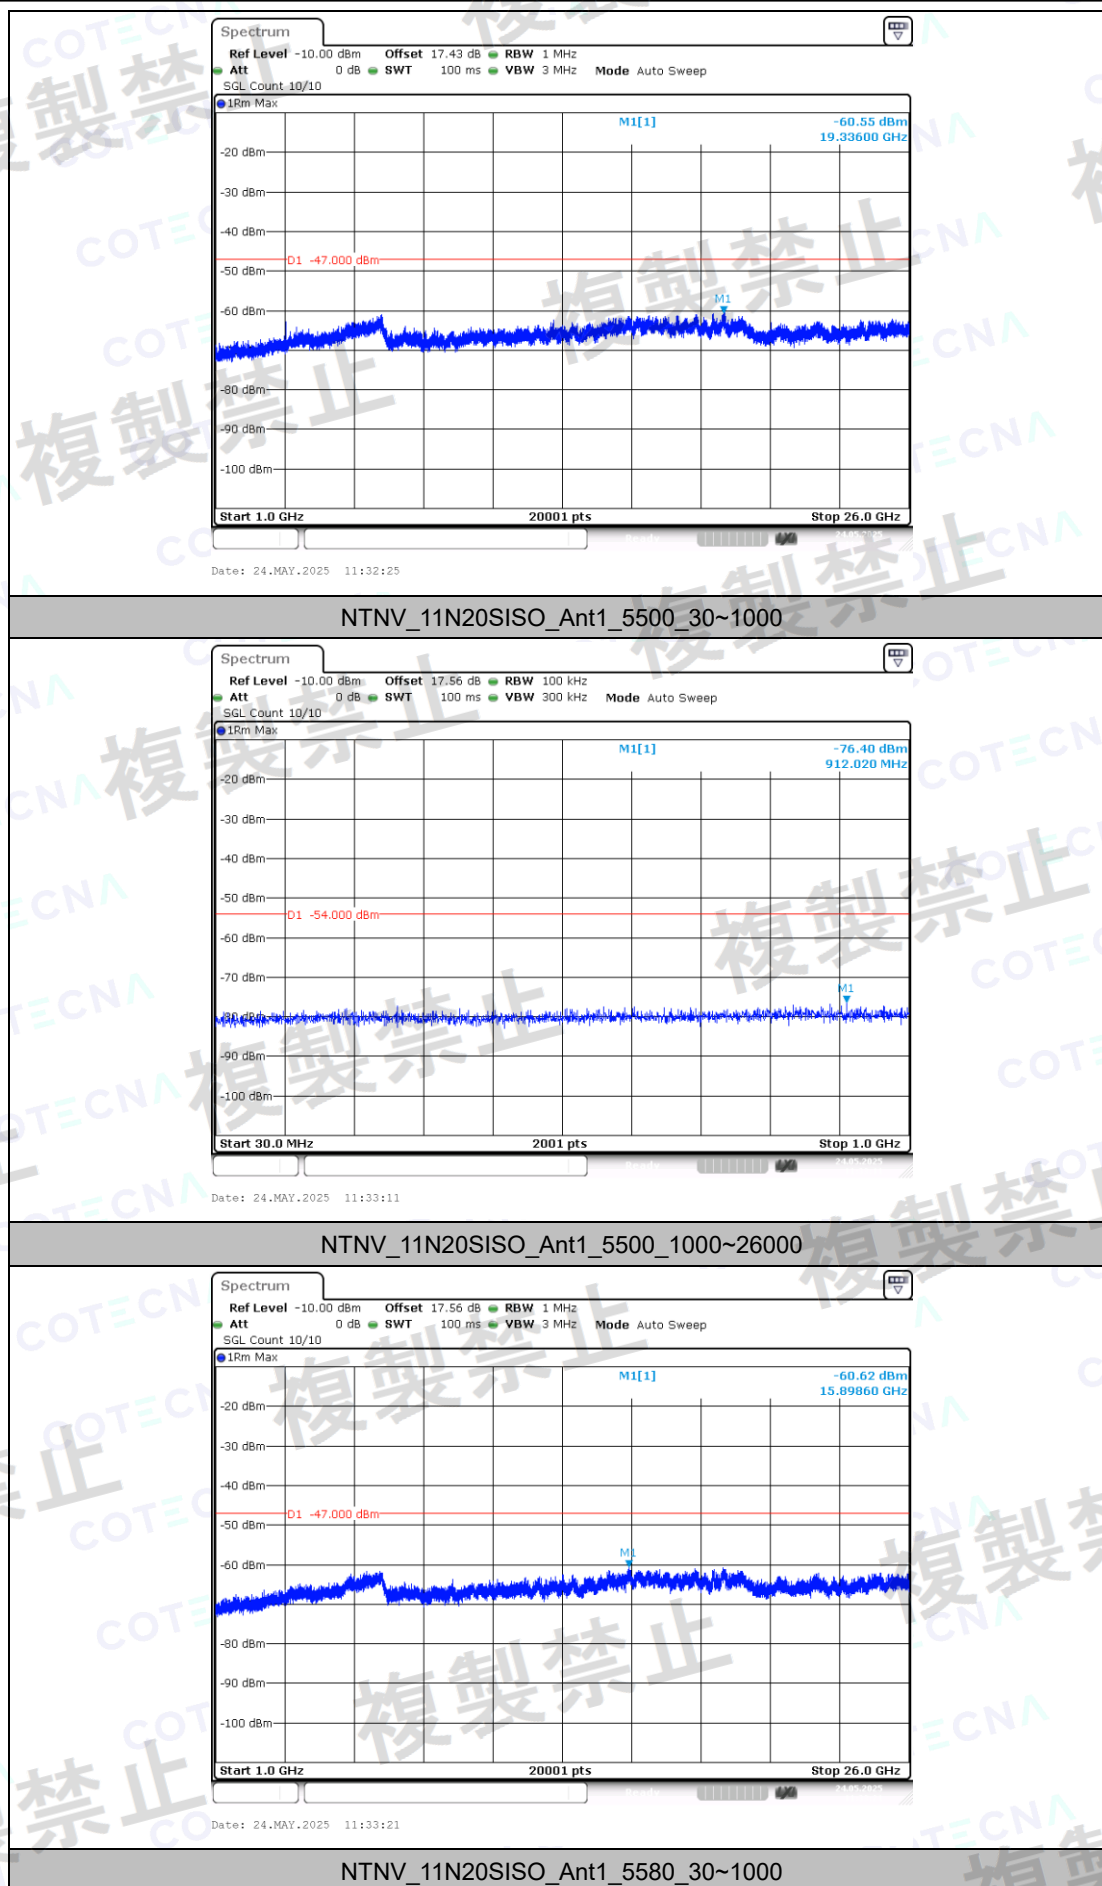




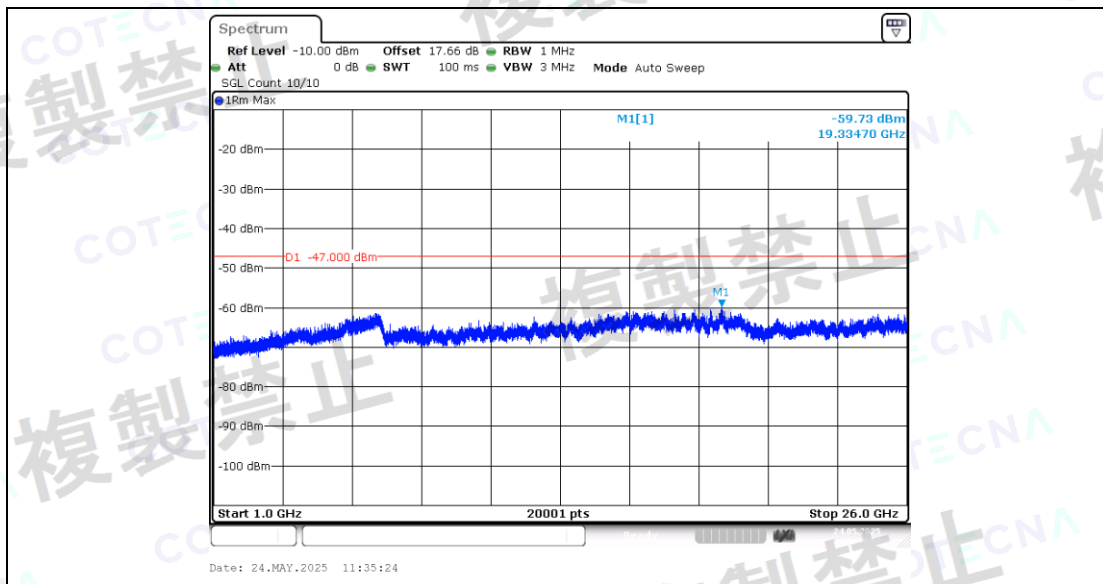

NTNV_11N20SISO_Ant1_5700_30~1000

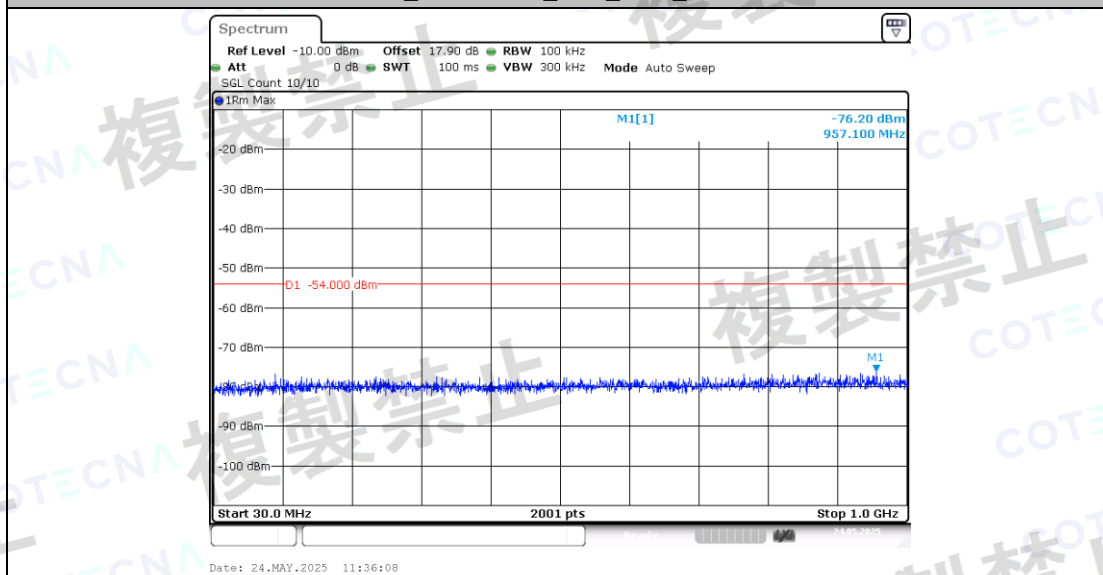


NTNV_11N20SISO_Ant1_5700_1000~26000

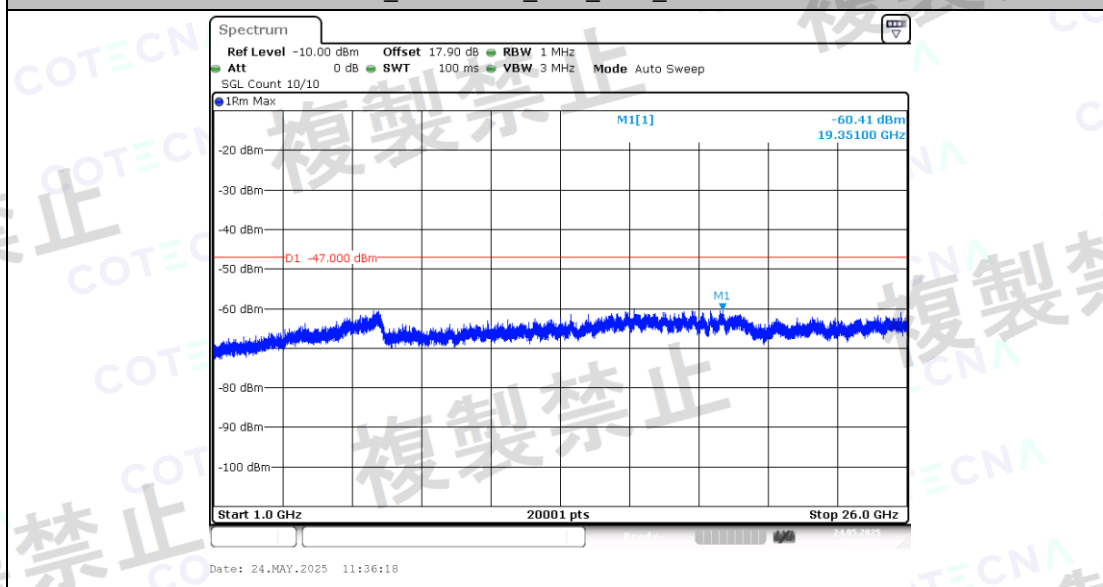



NTNV_11N20SISO_Ant1_5720_30~1000



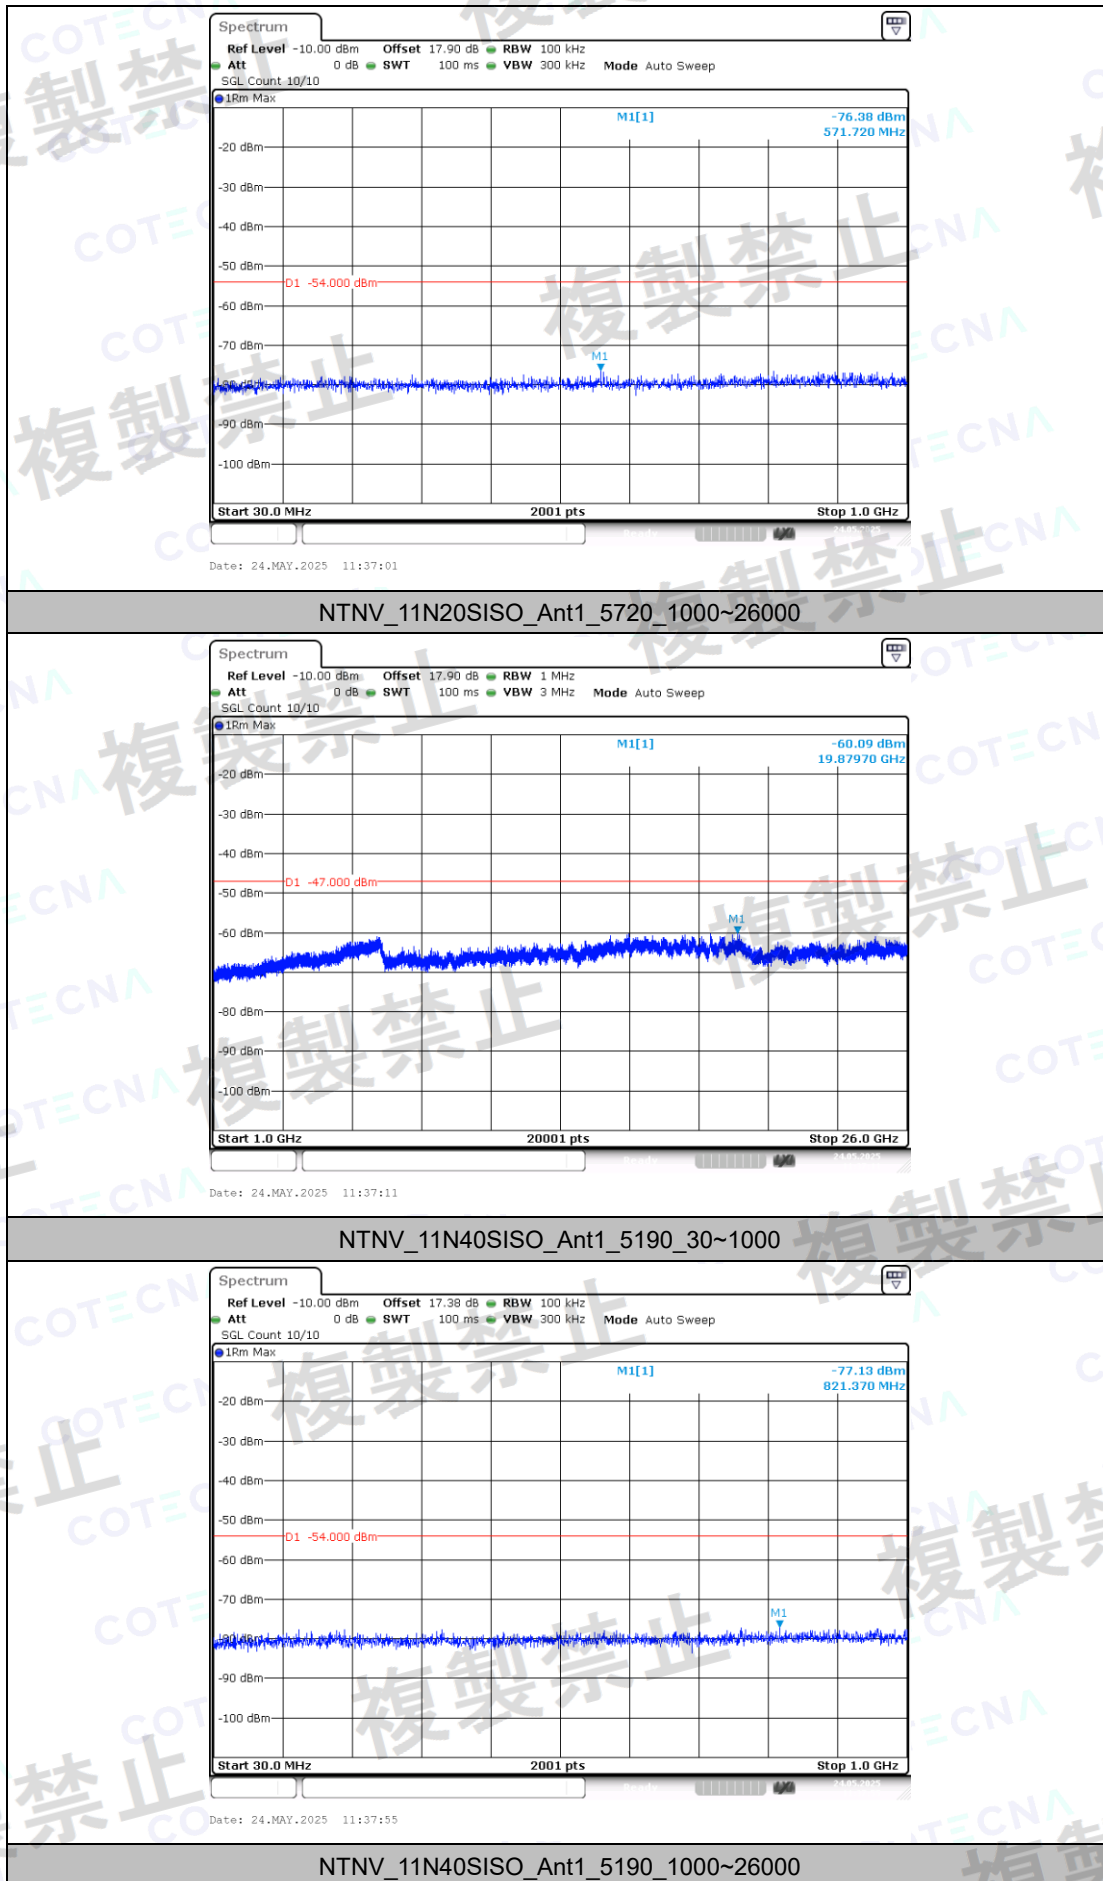




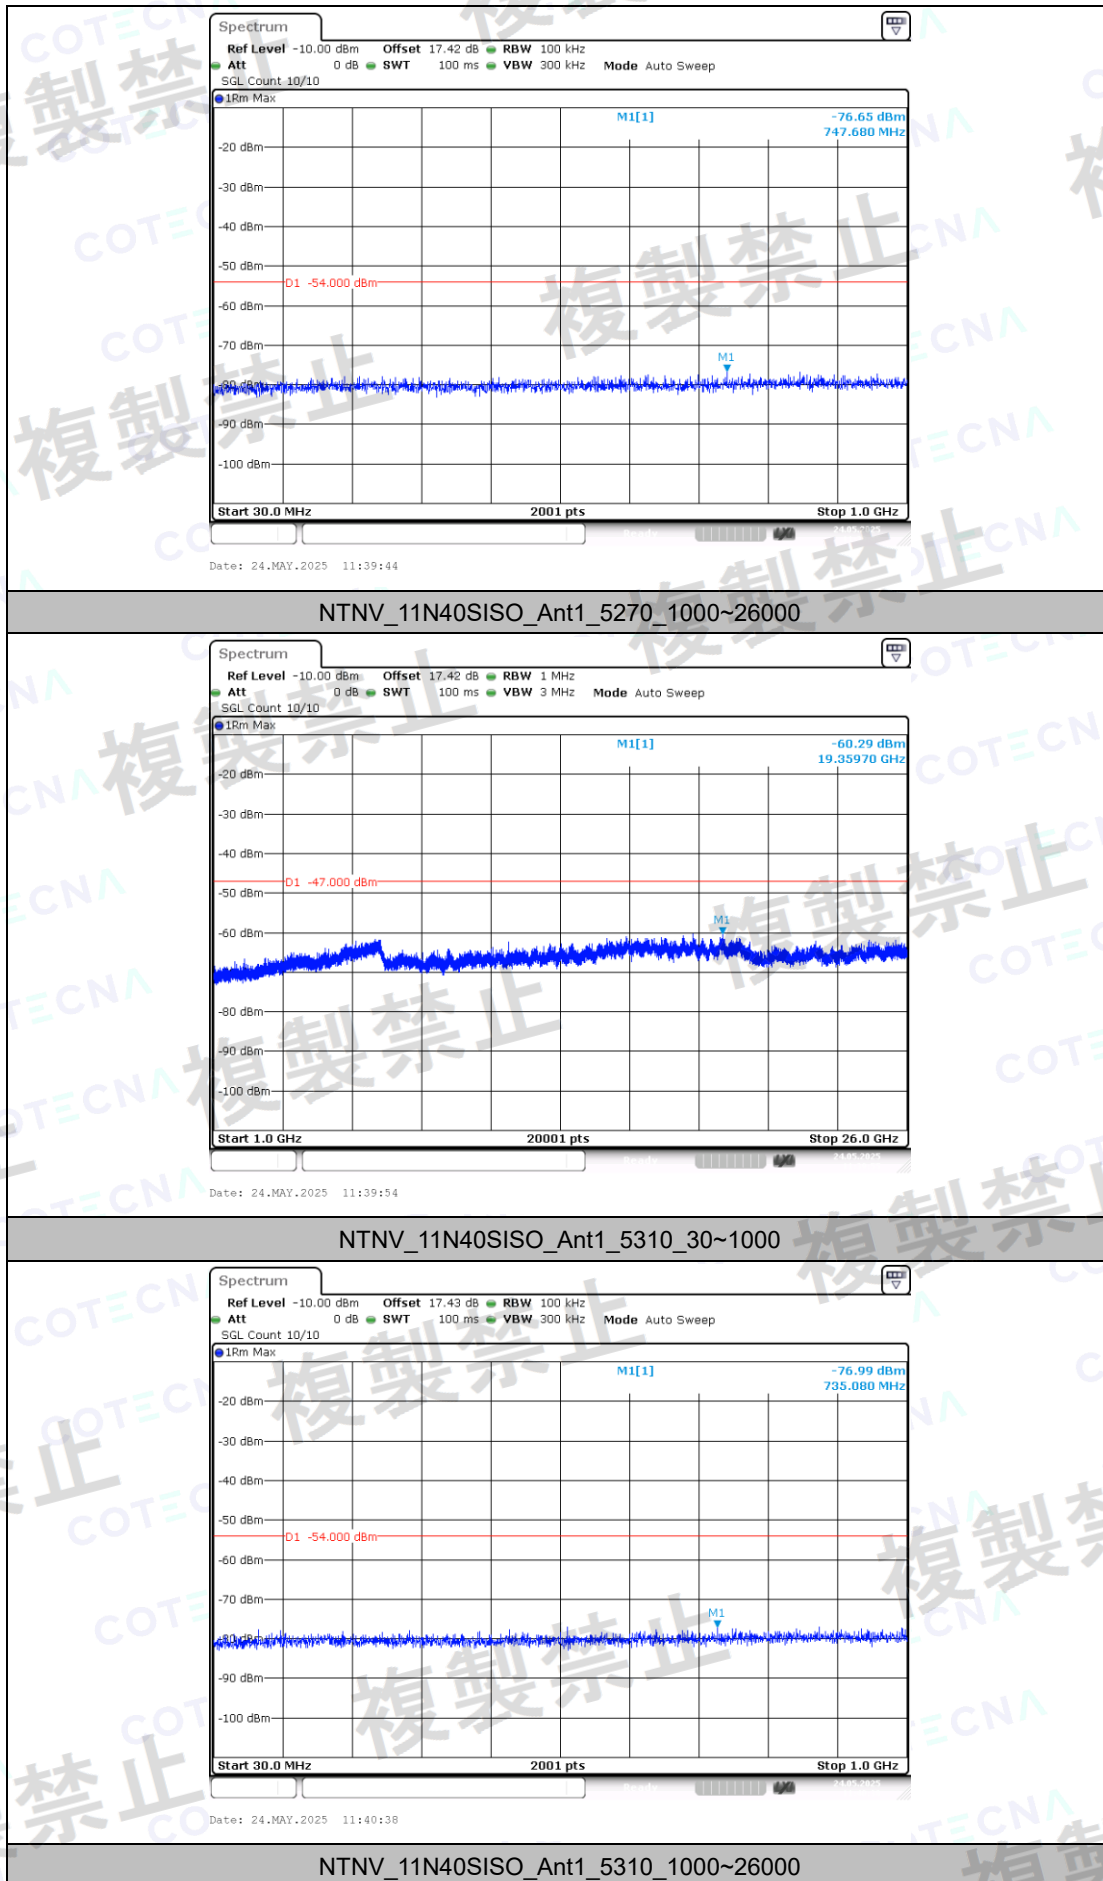


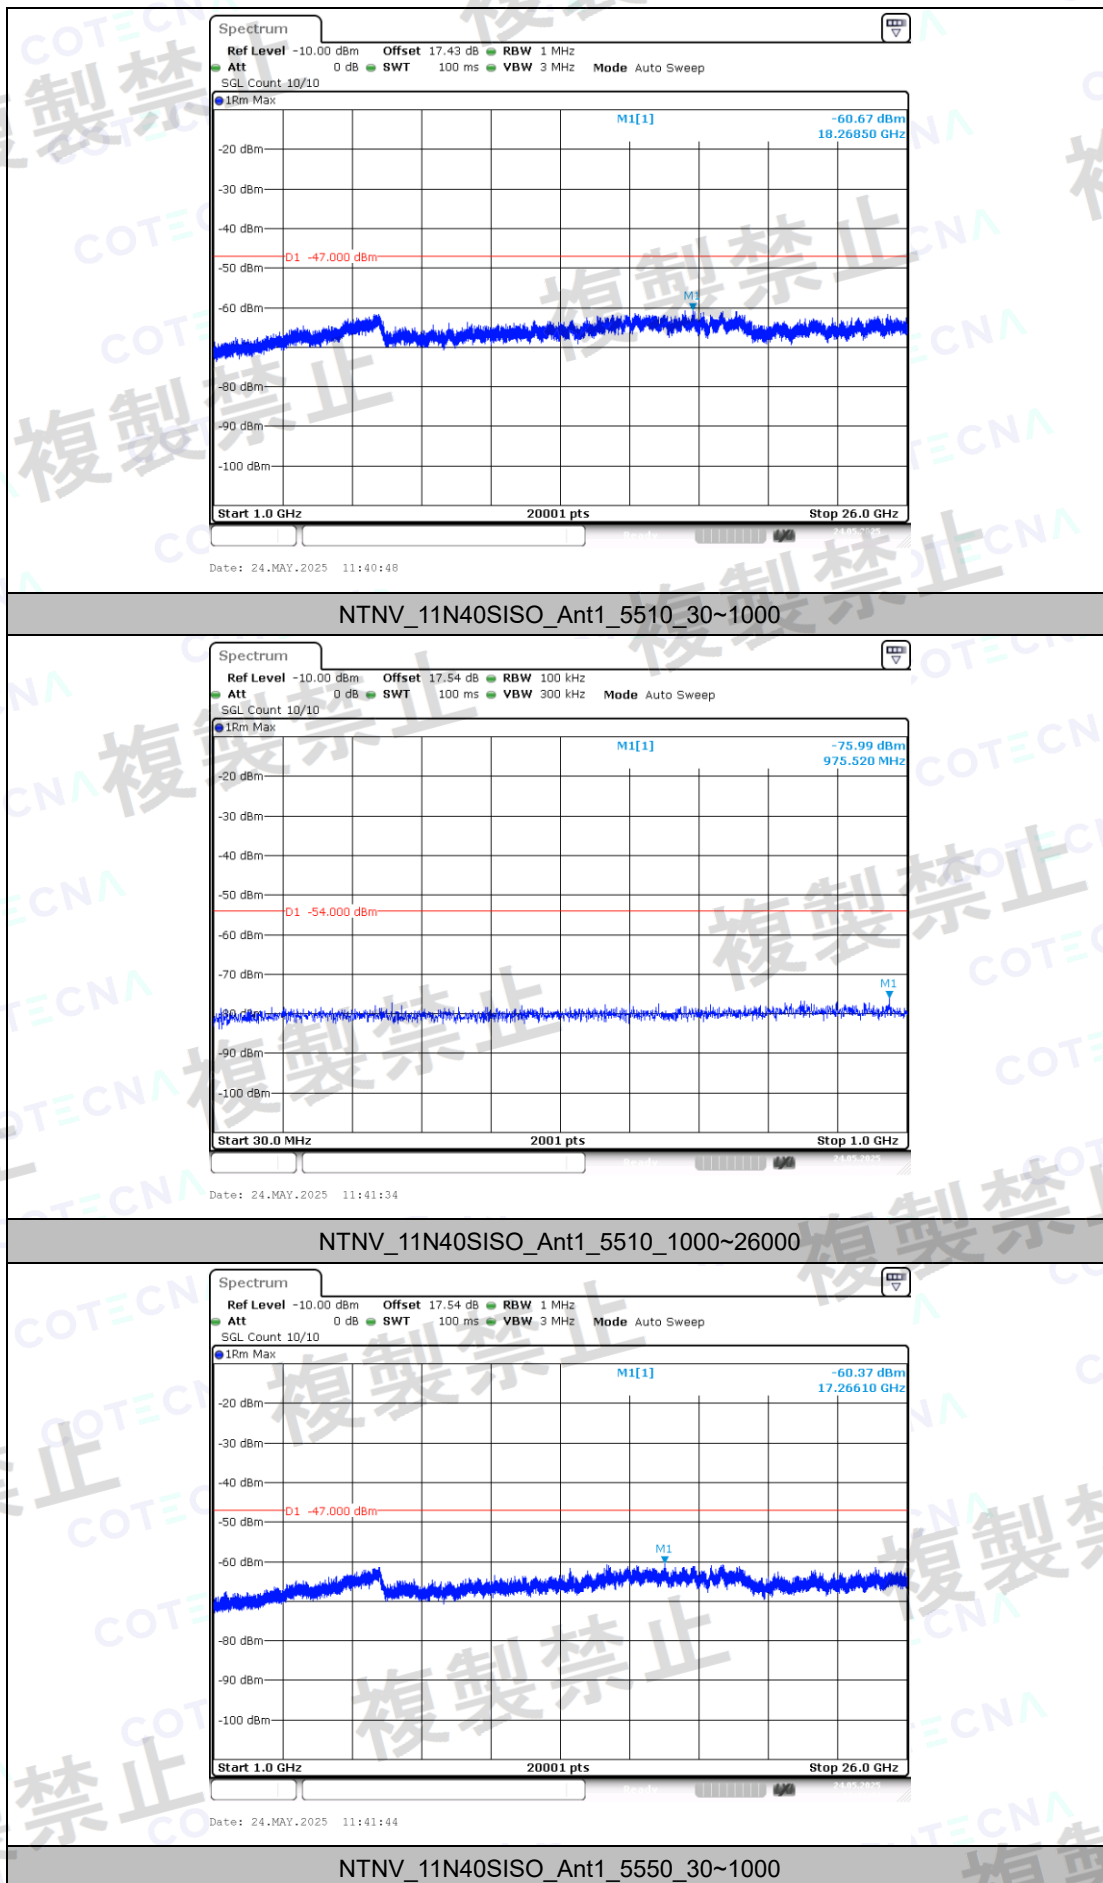





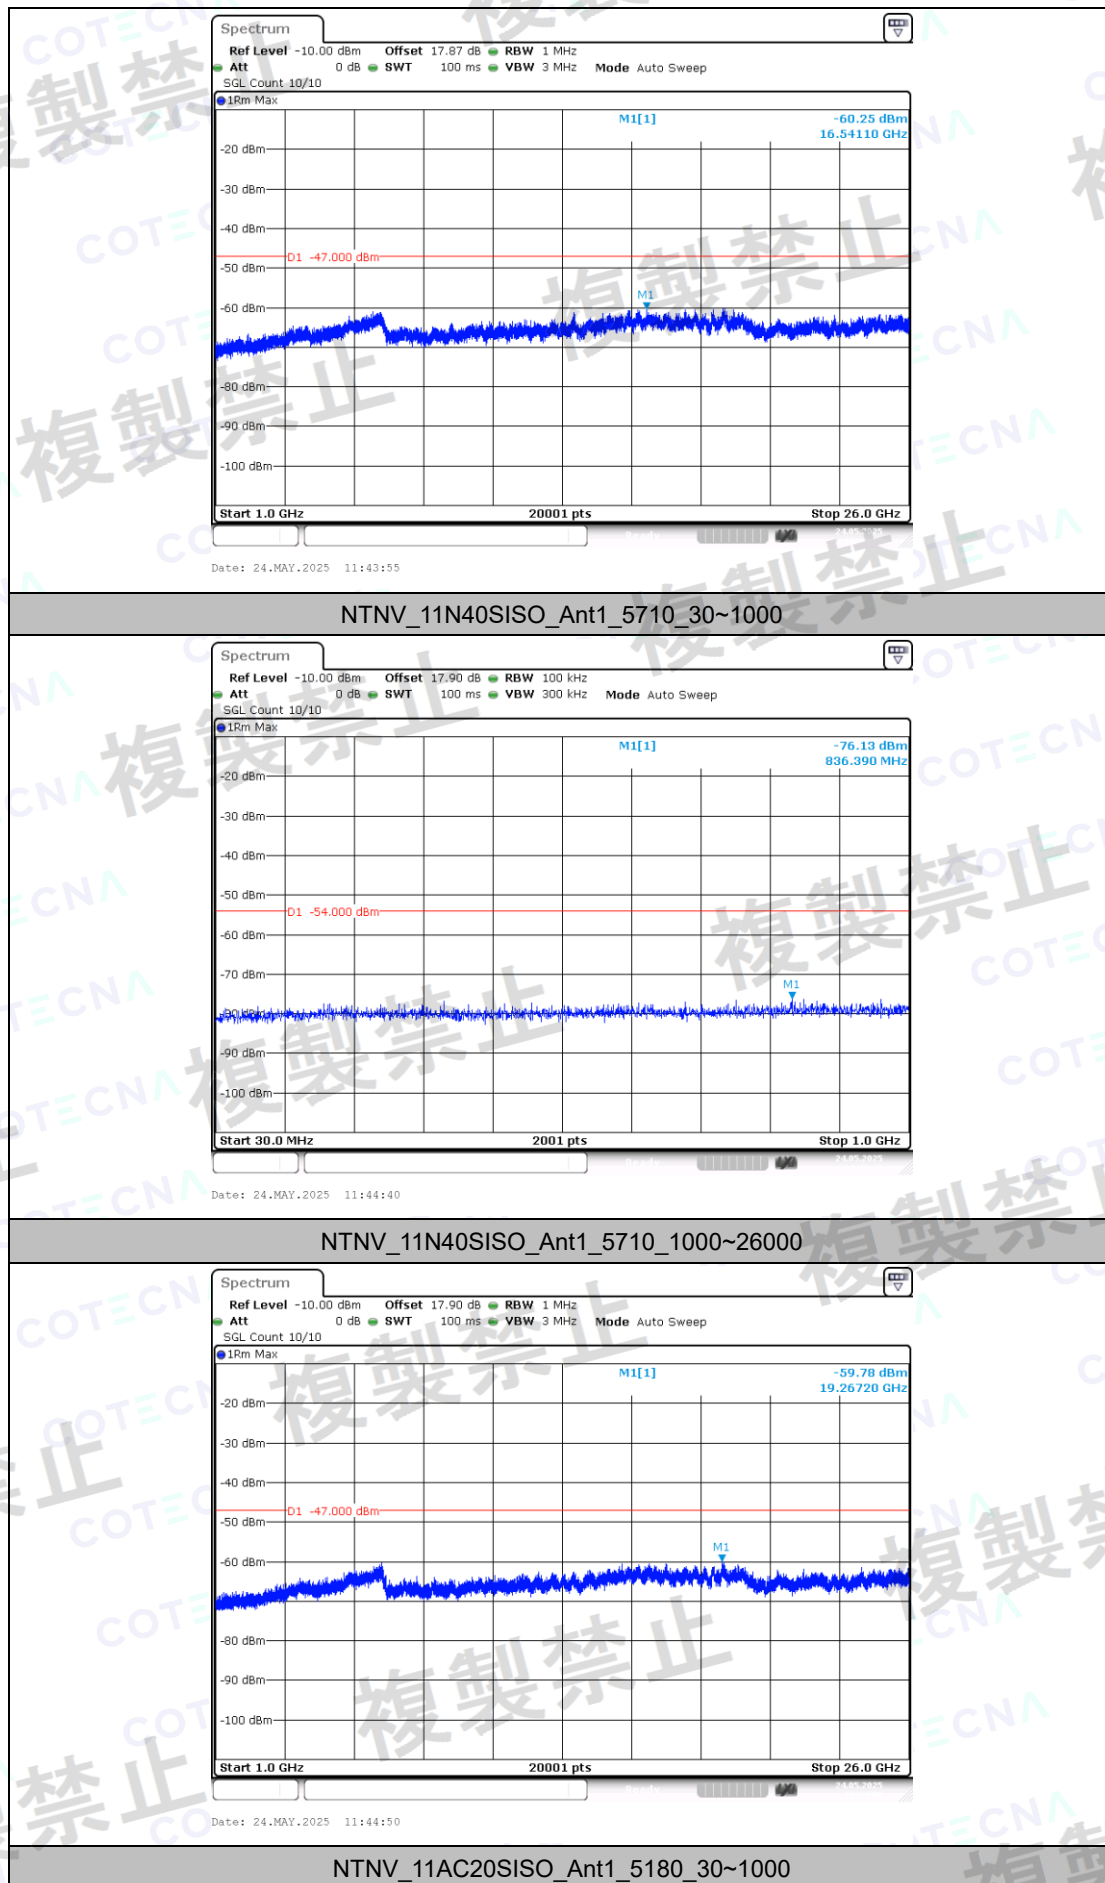




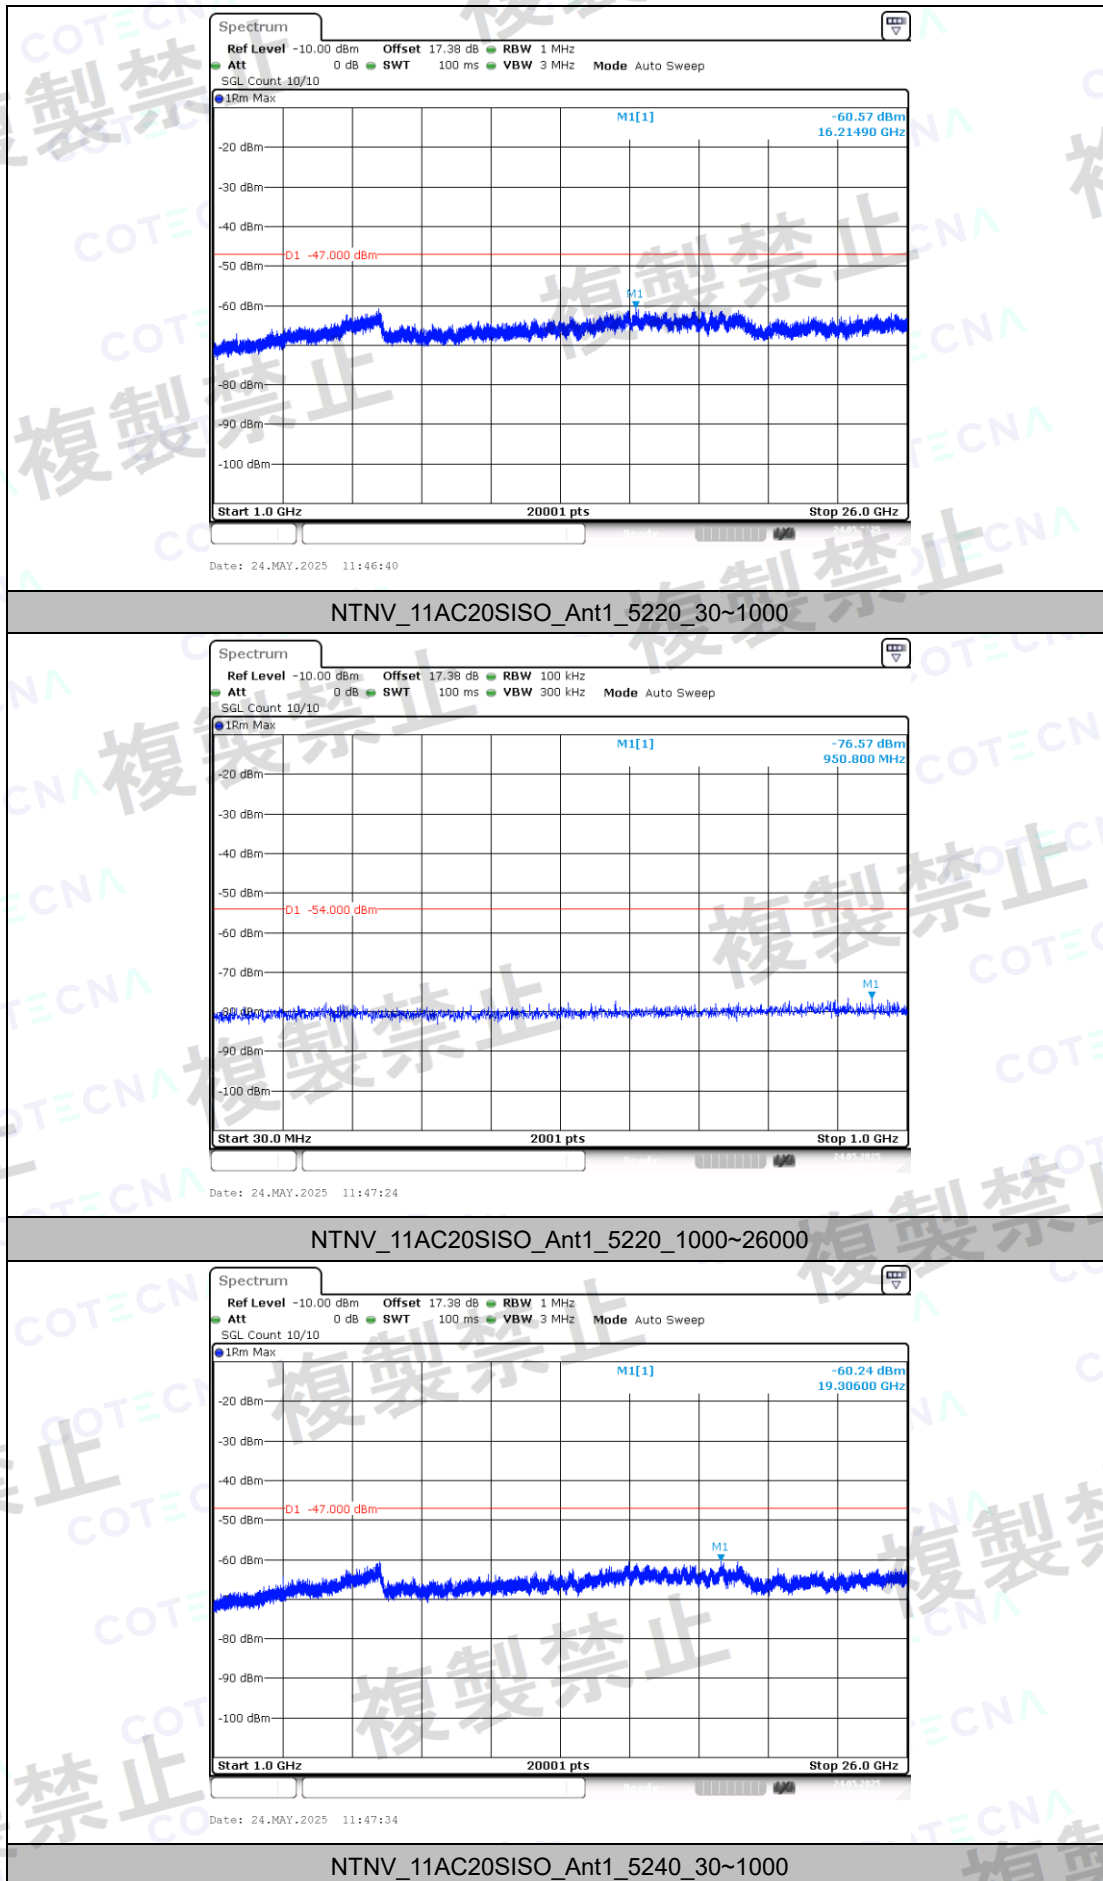

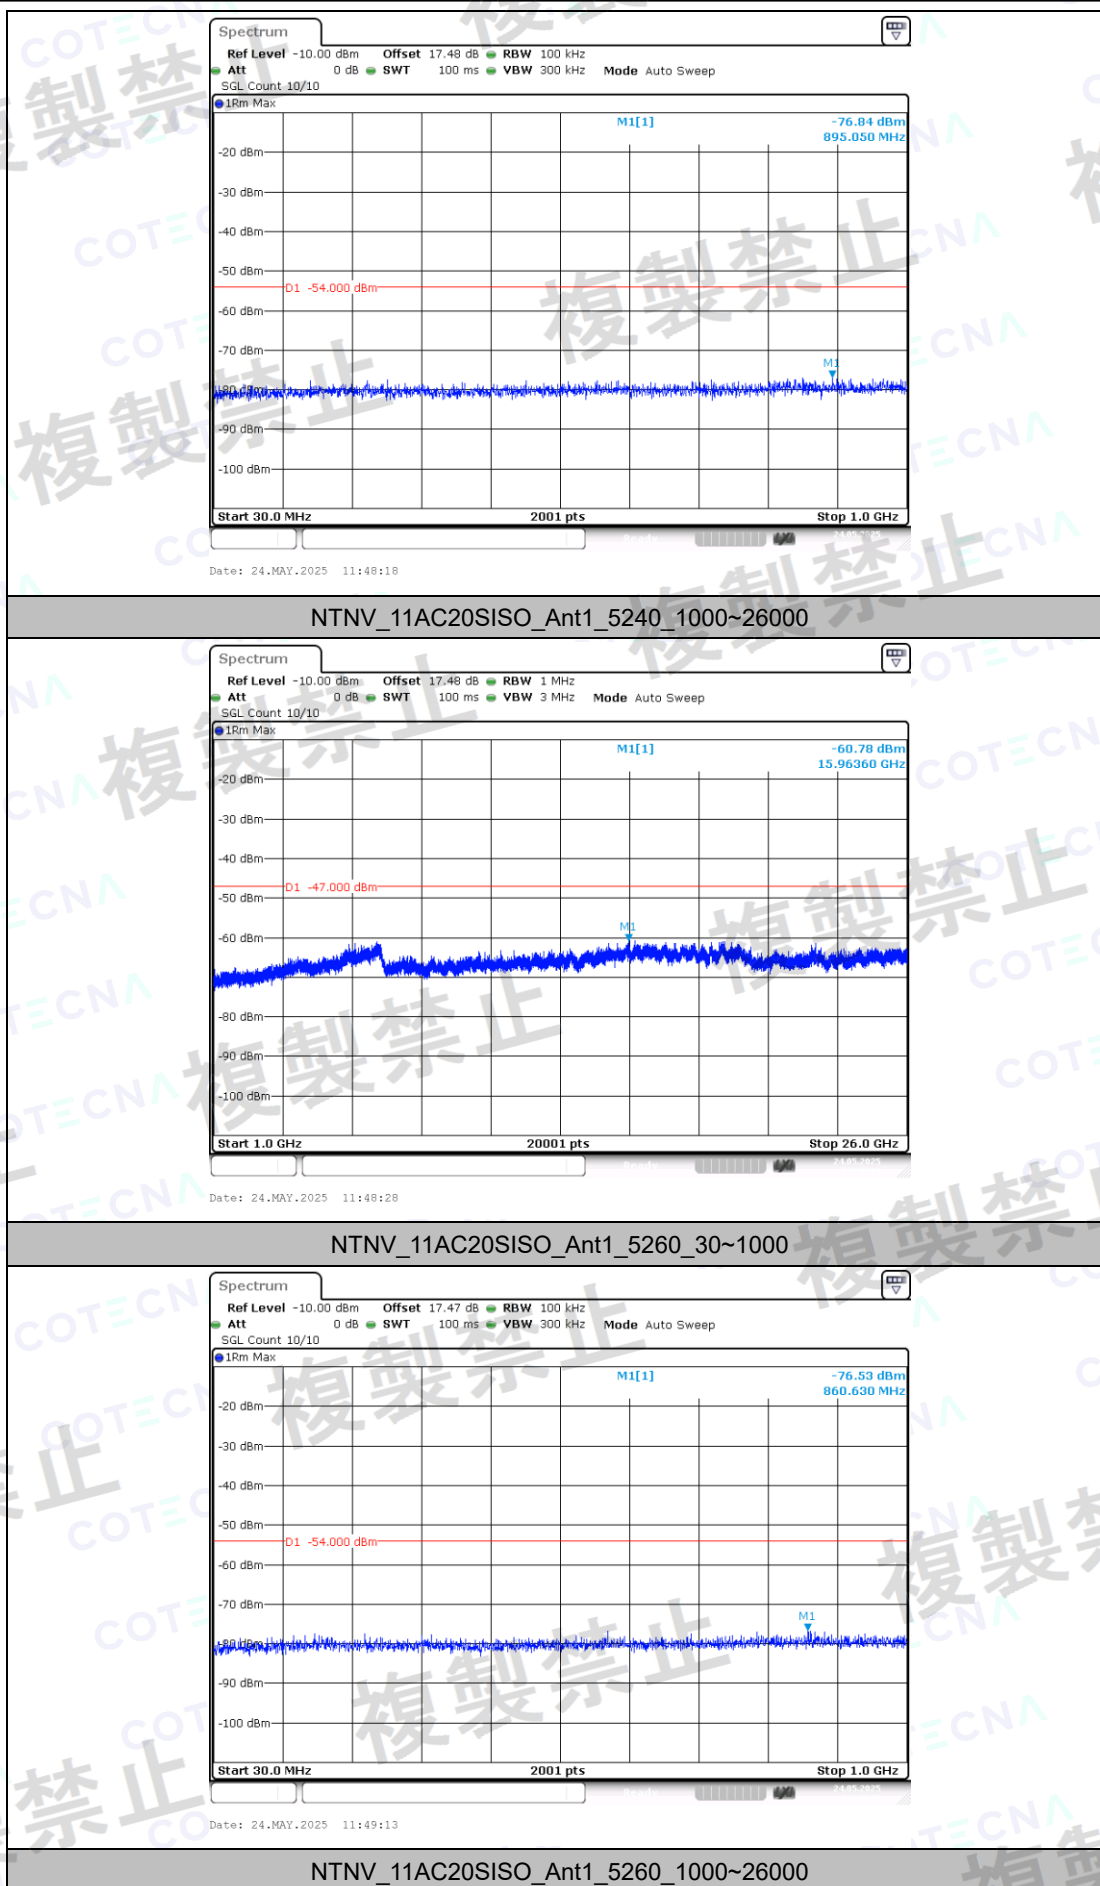


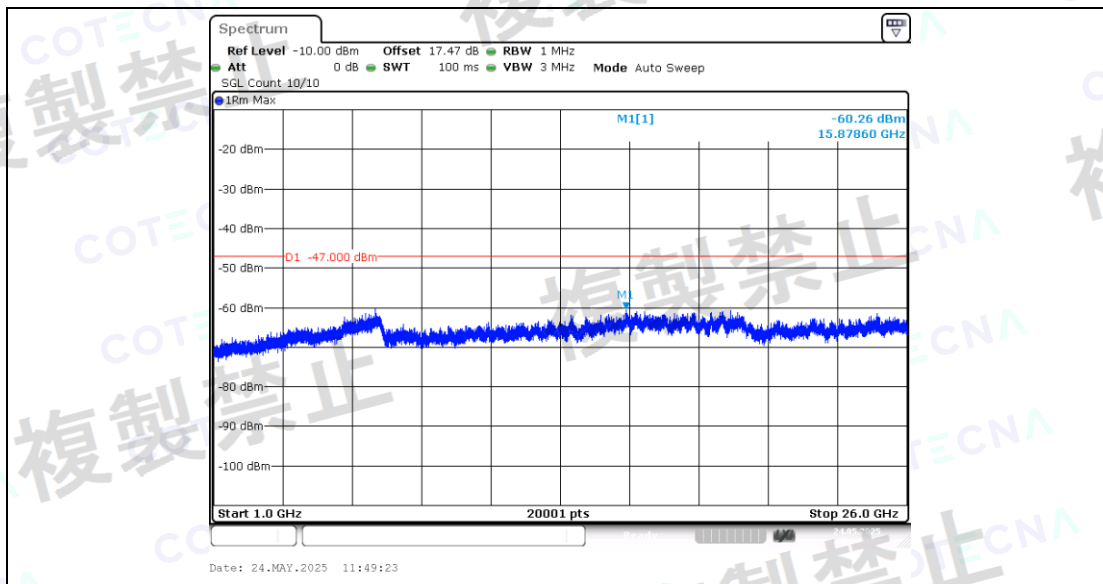

NTVN_11AC20SISO_Ant1_5280_30~1000

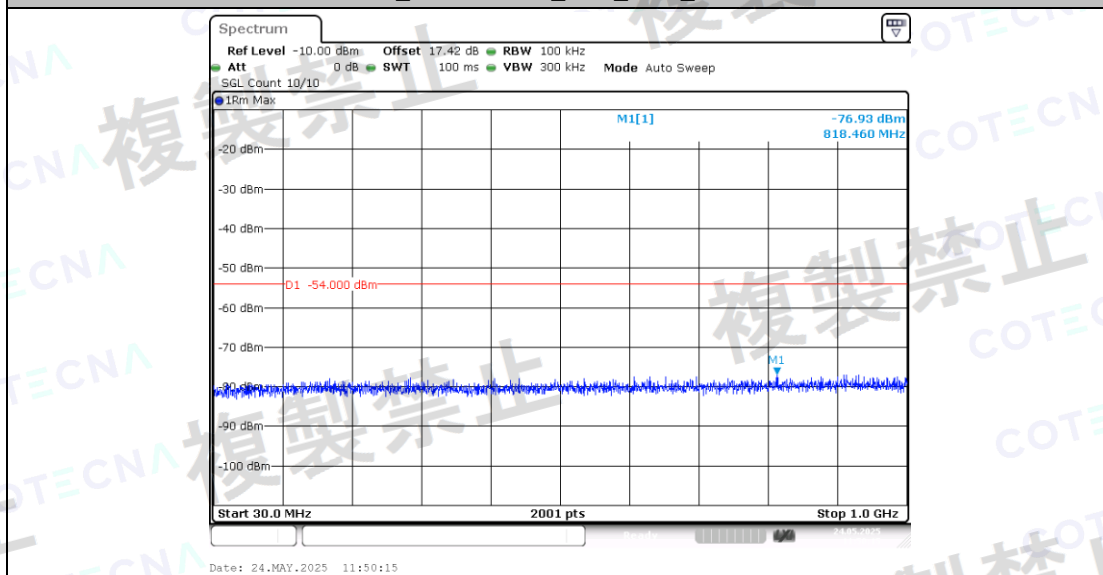



NTVN_11AC20SISO_Ant1_5280_1000~26000

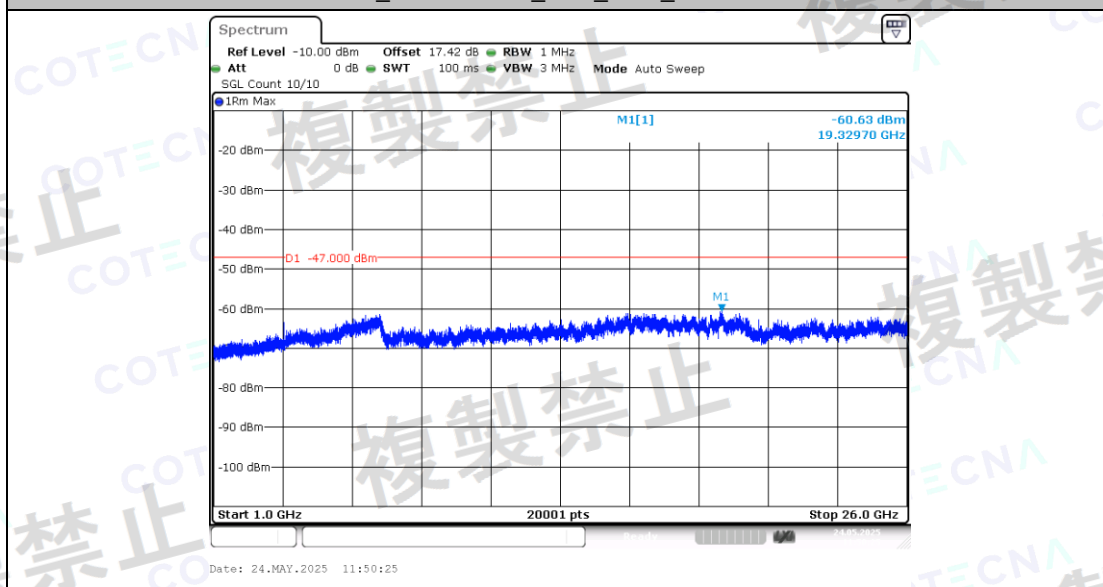


NTVN_11AC20SISO_Ant1_5300_30~1000



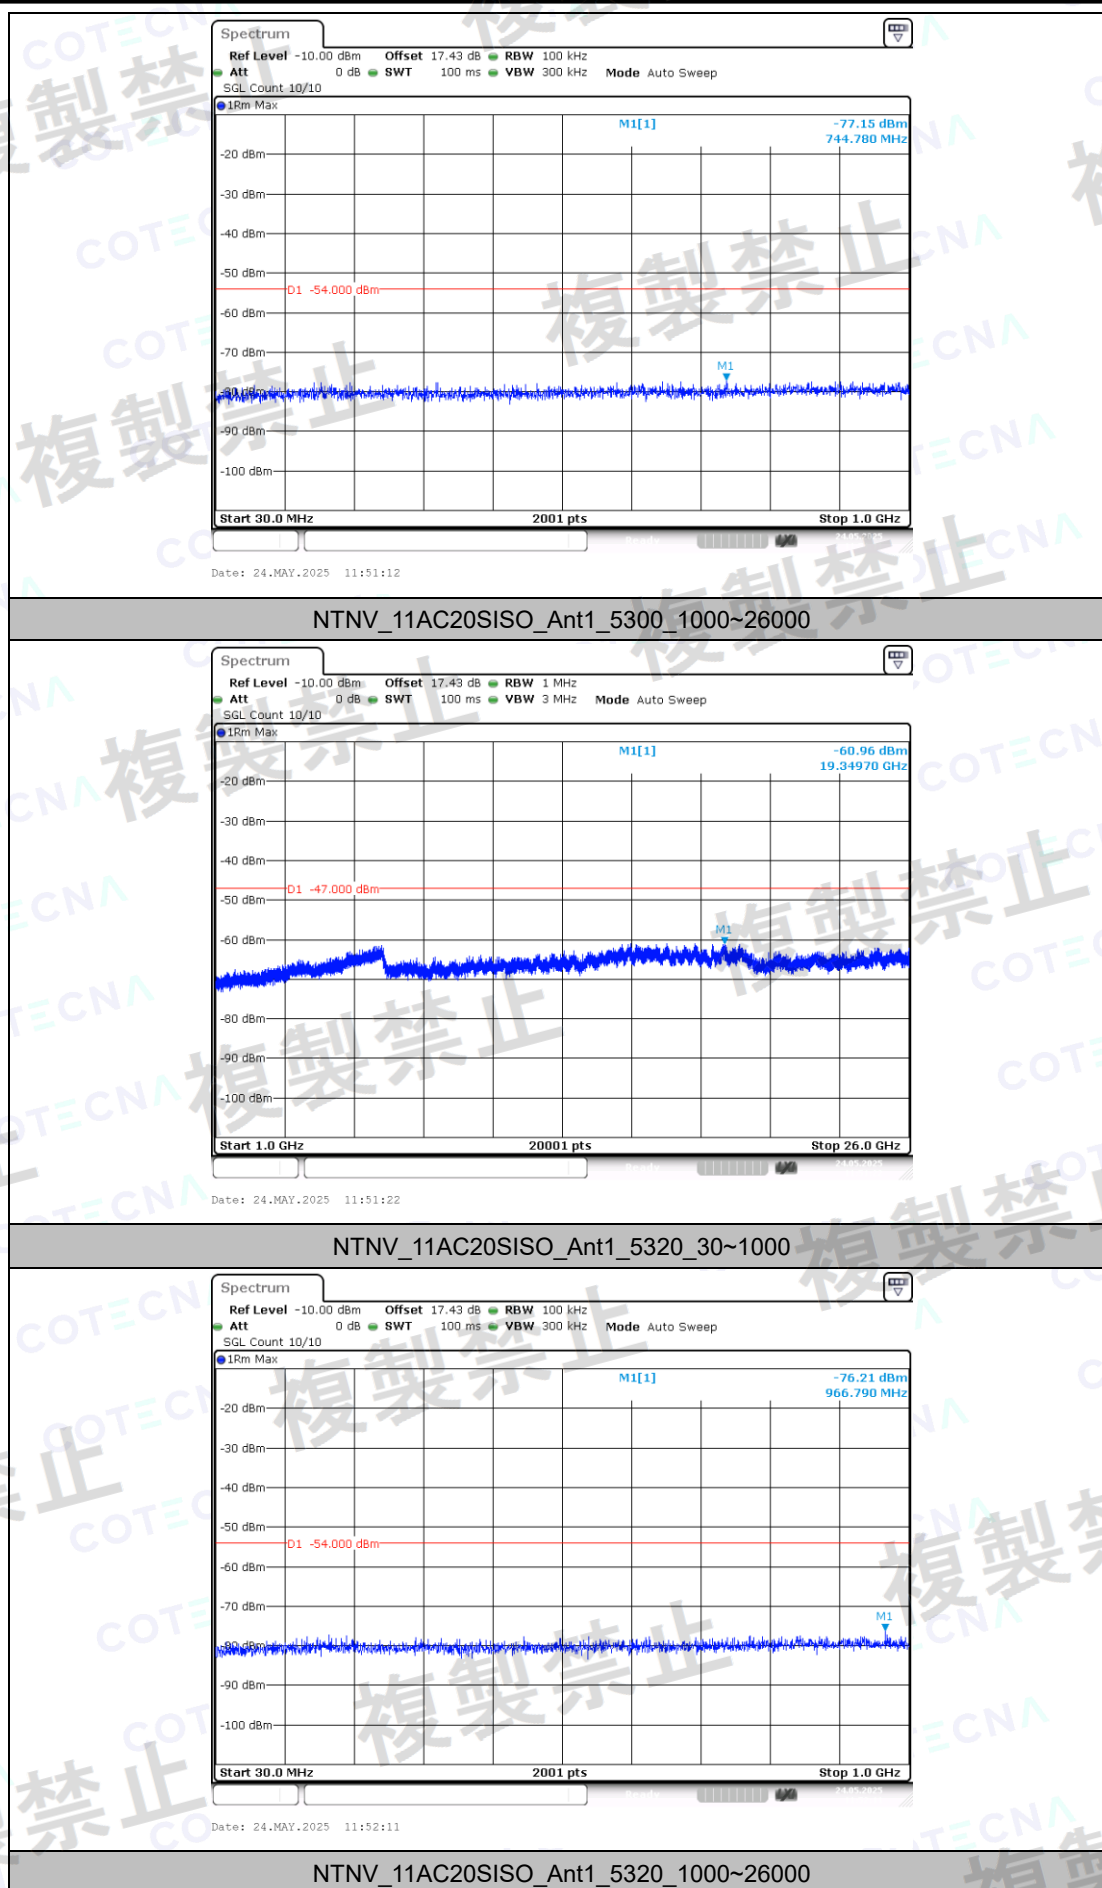


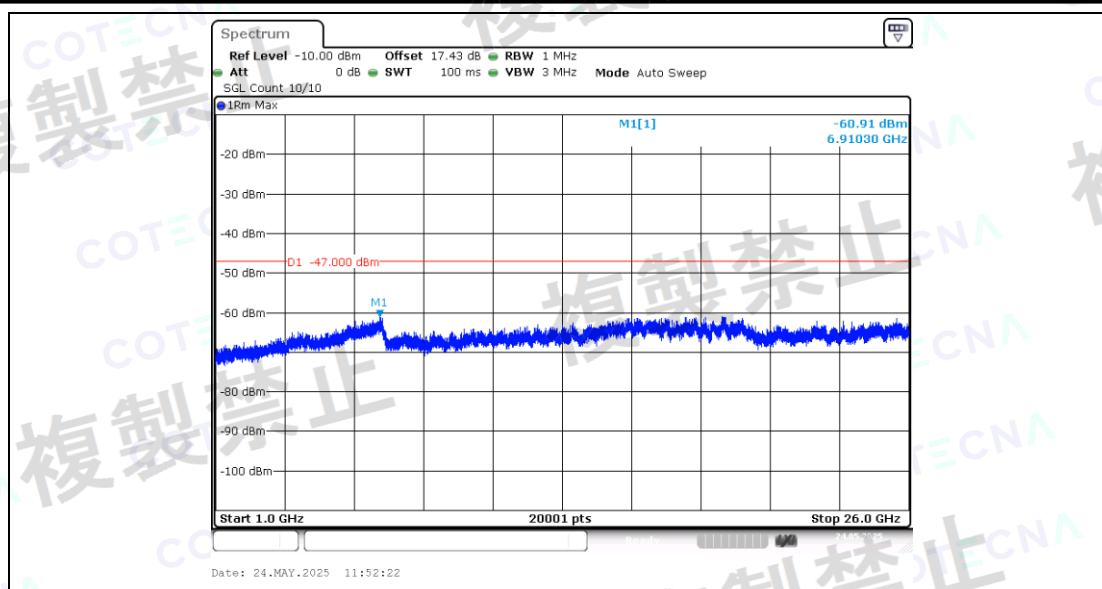

NTNV_11AC20SISO_Ant1_5500_30~1000

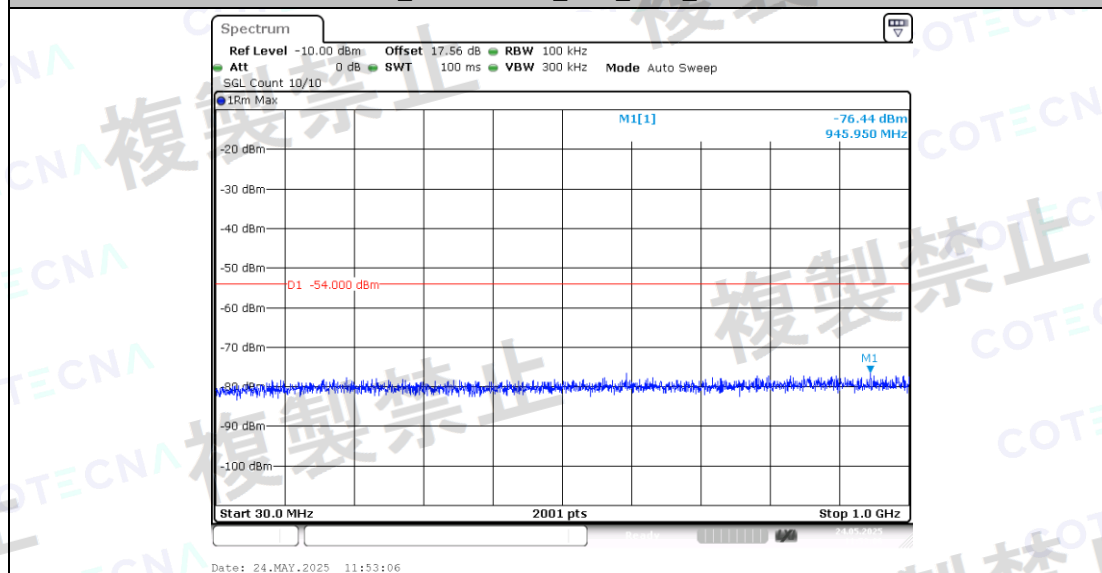



NTNV_11AC20SISO_Ant1_5500_1000~26000

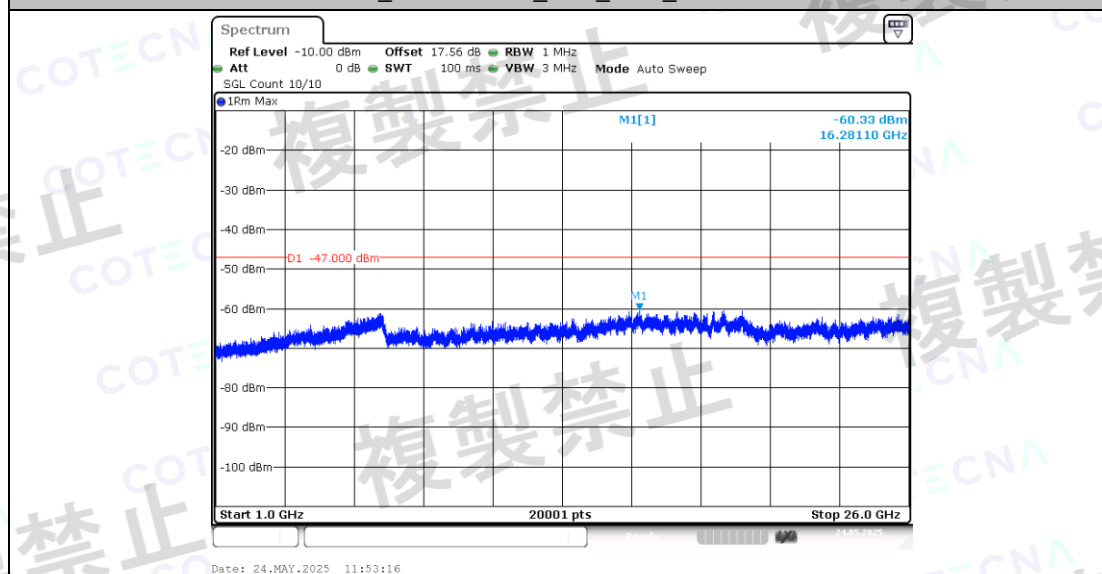


NTNV_11AC20SISO_Ant1_5580_30~1000



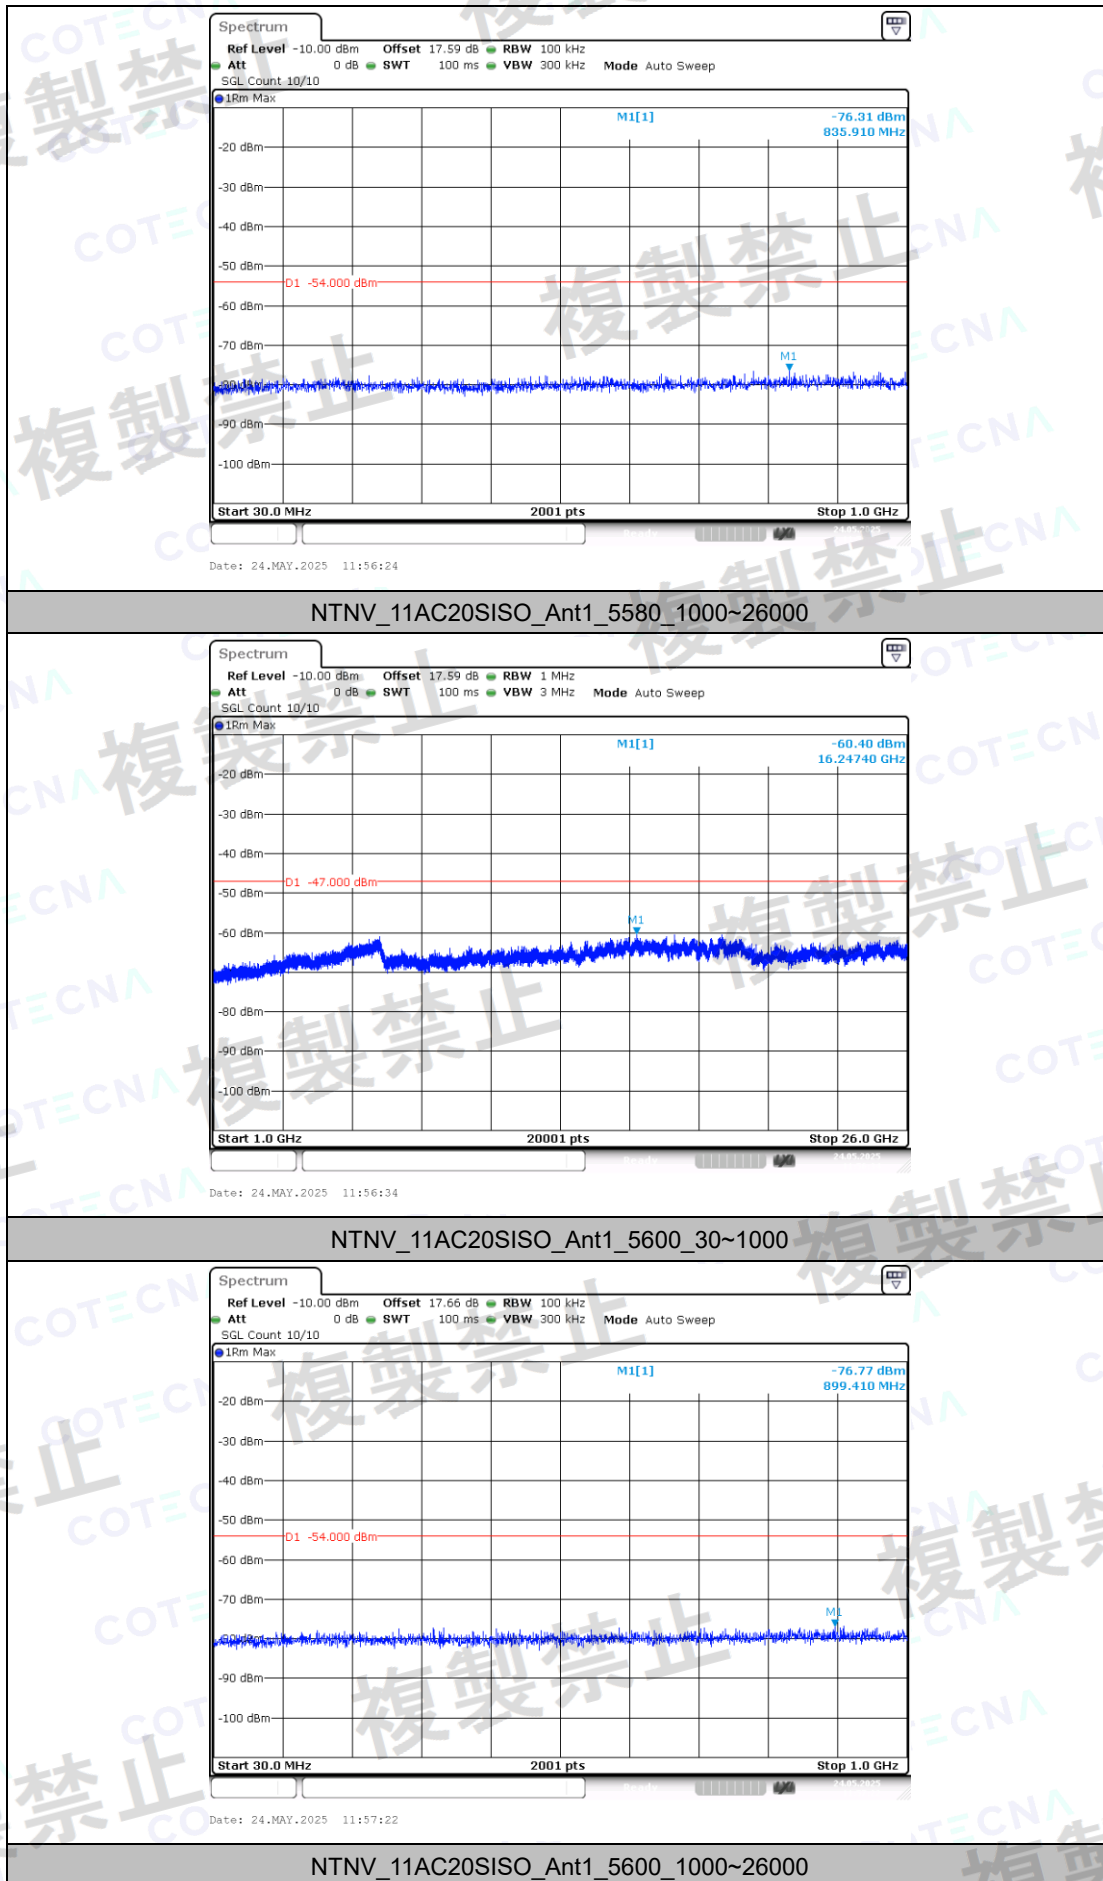


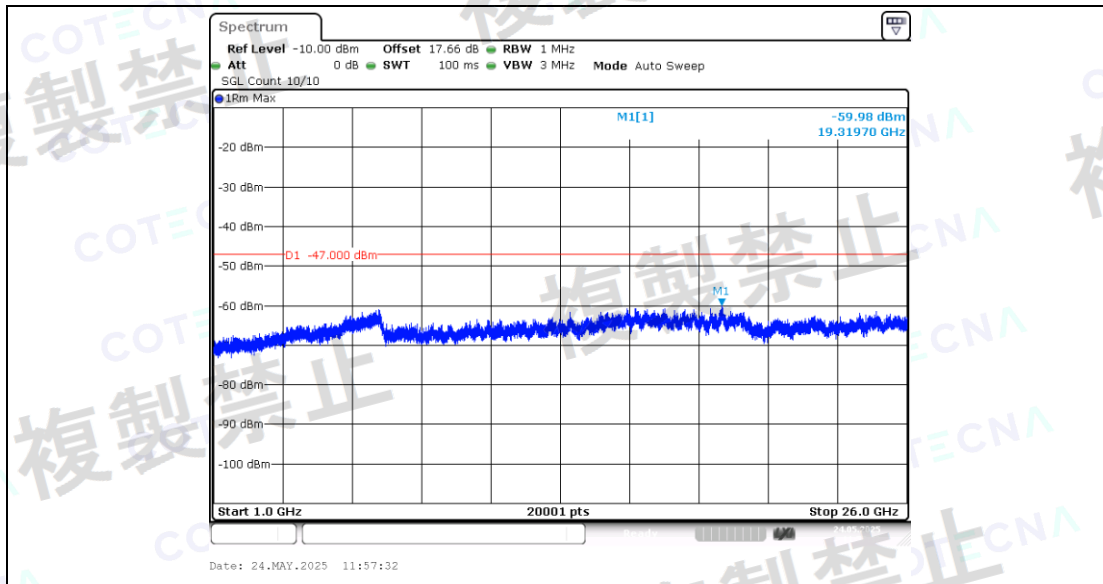

NTVN_11AC20SISO_Ant1_5700_30~1000

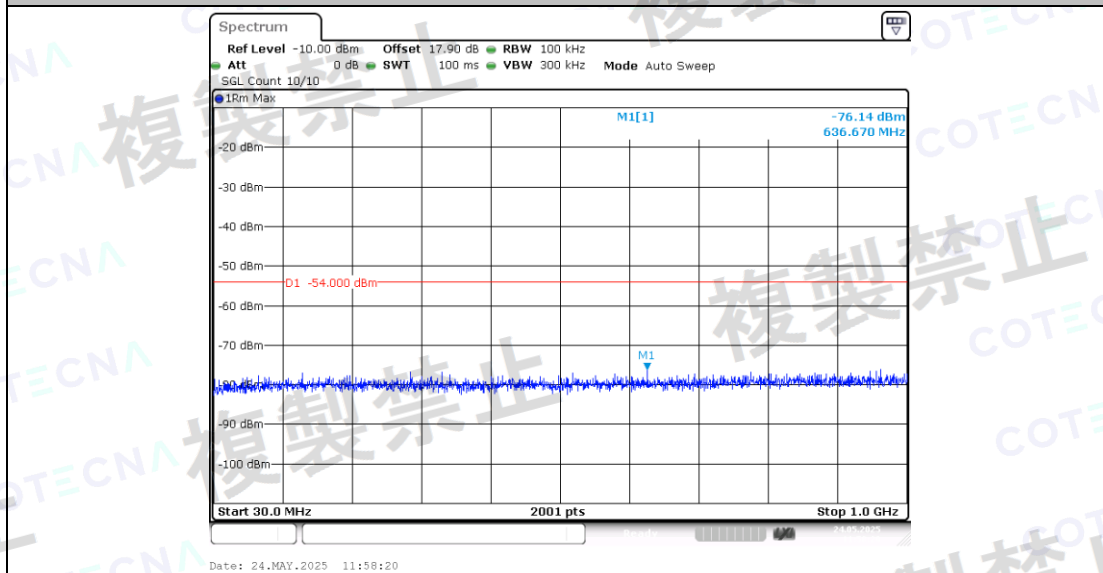



NTVN_11AC20SISO_Ant1_5700_1000~26000

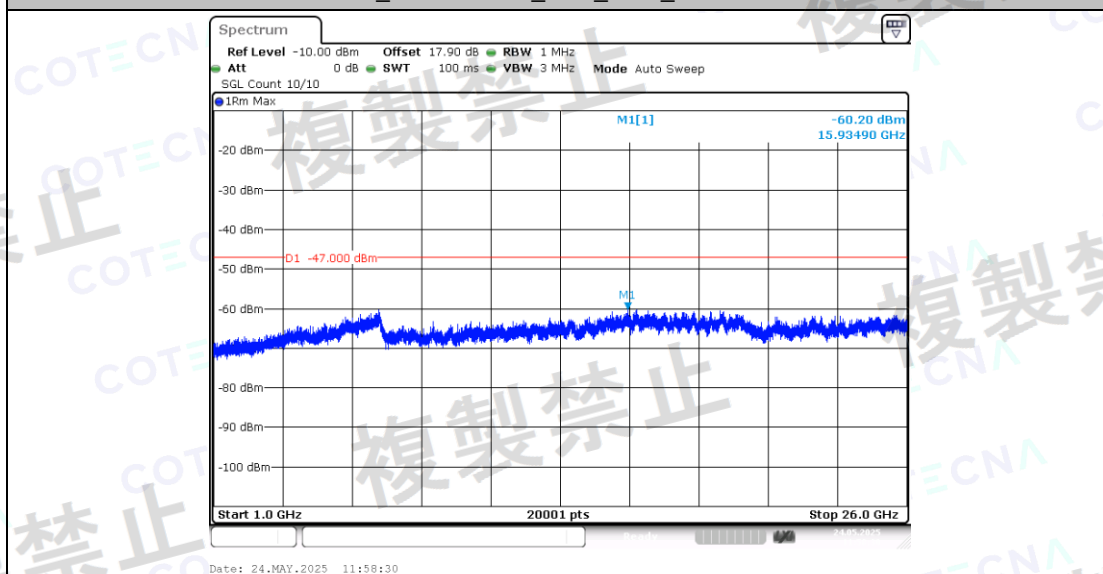


NTVN_11AC20SISO_Ant1_5720_30~1000



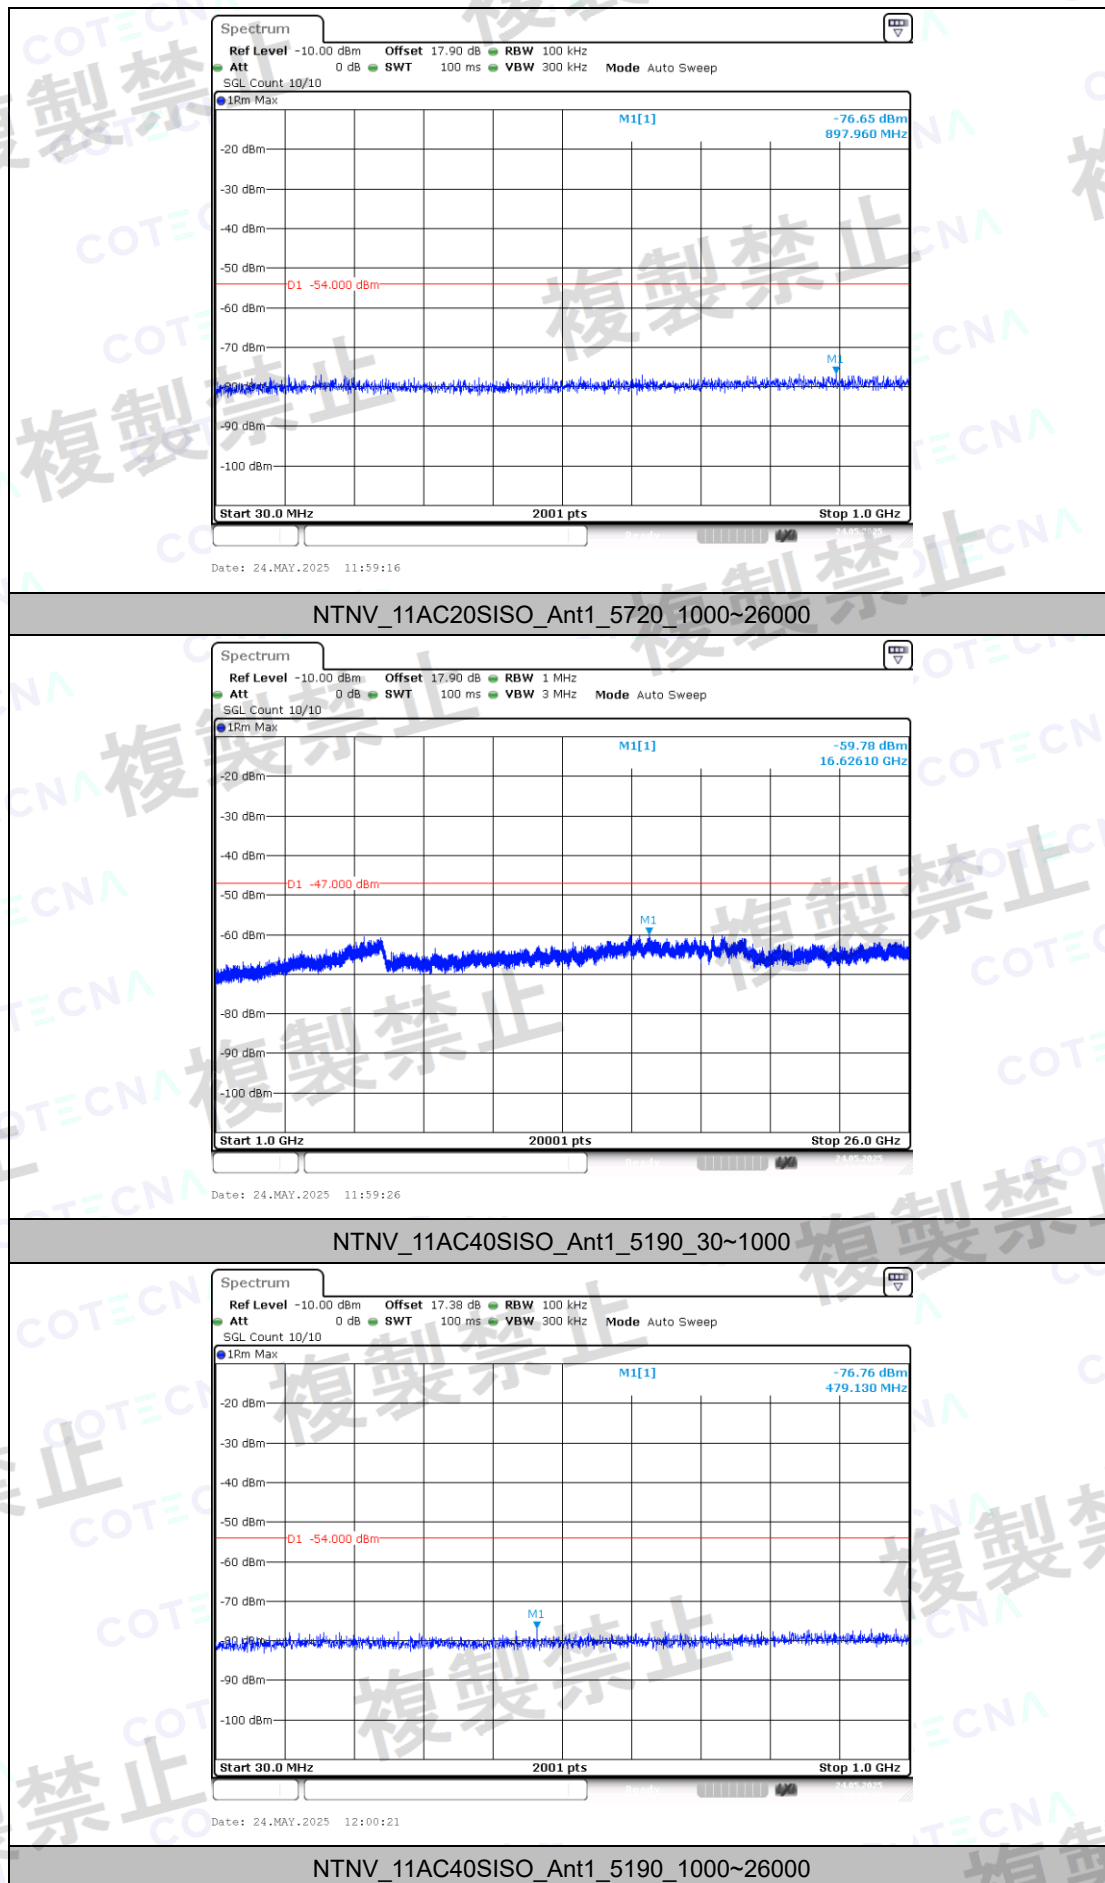


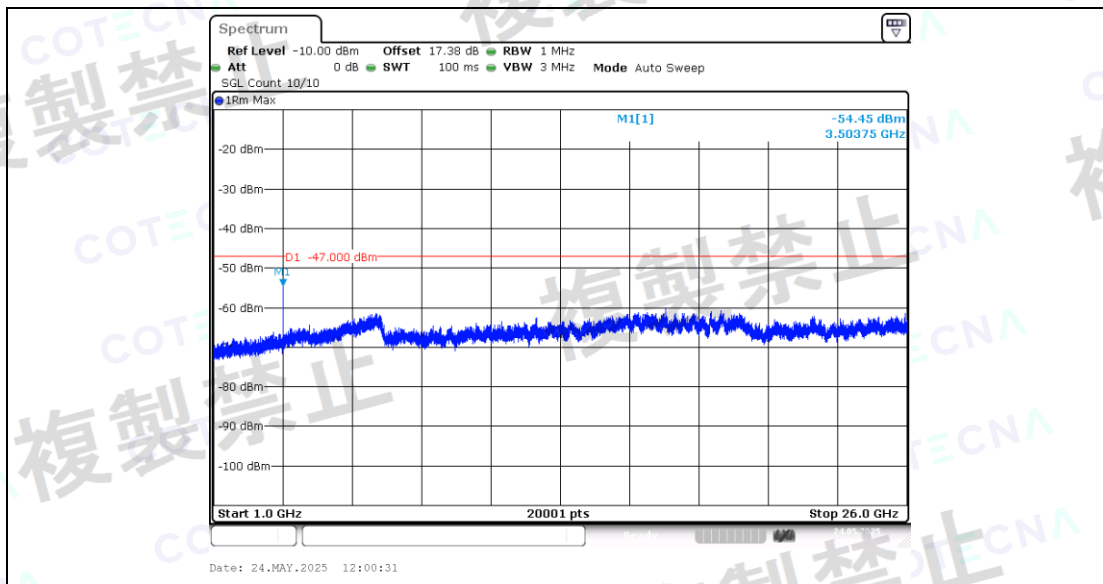

NTVN_11AC40SISO_Ant1_5230_30~1000

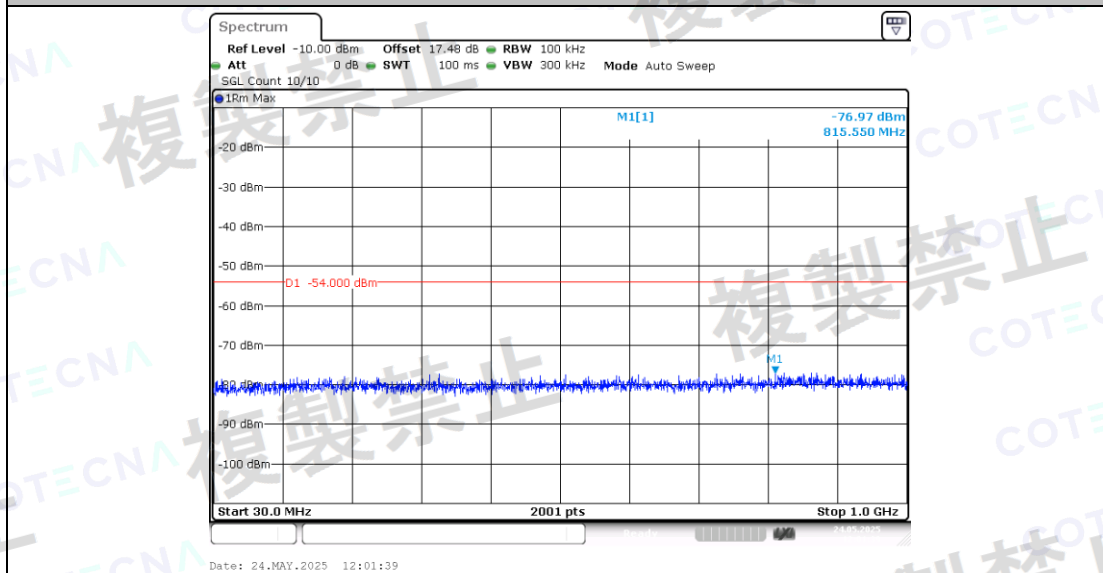



NTVN_11AC40SISO_Ant1_5230_1000~26000

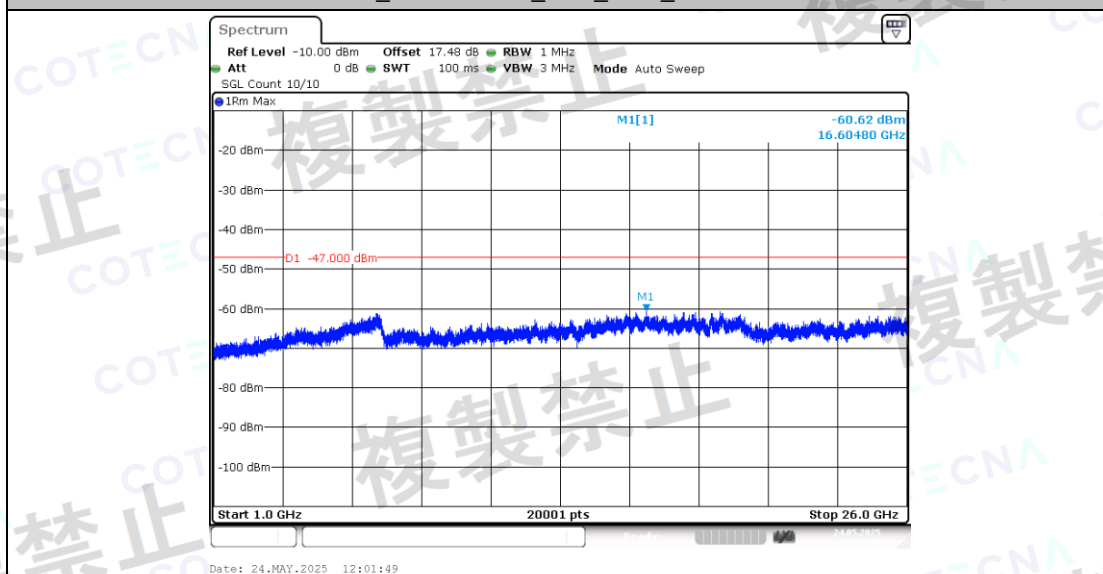


NTVN_11AC40SISO_Ant1_5270_30~1000



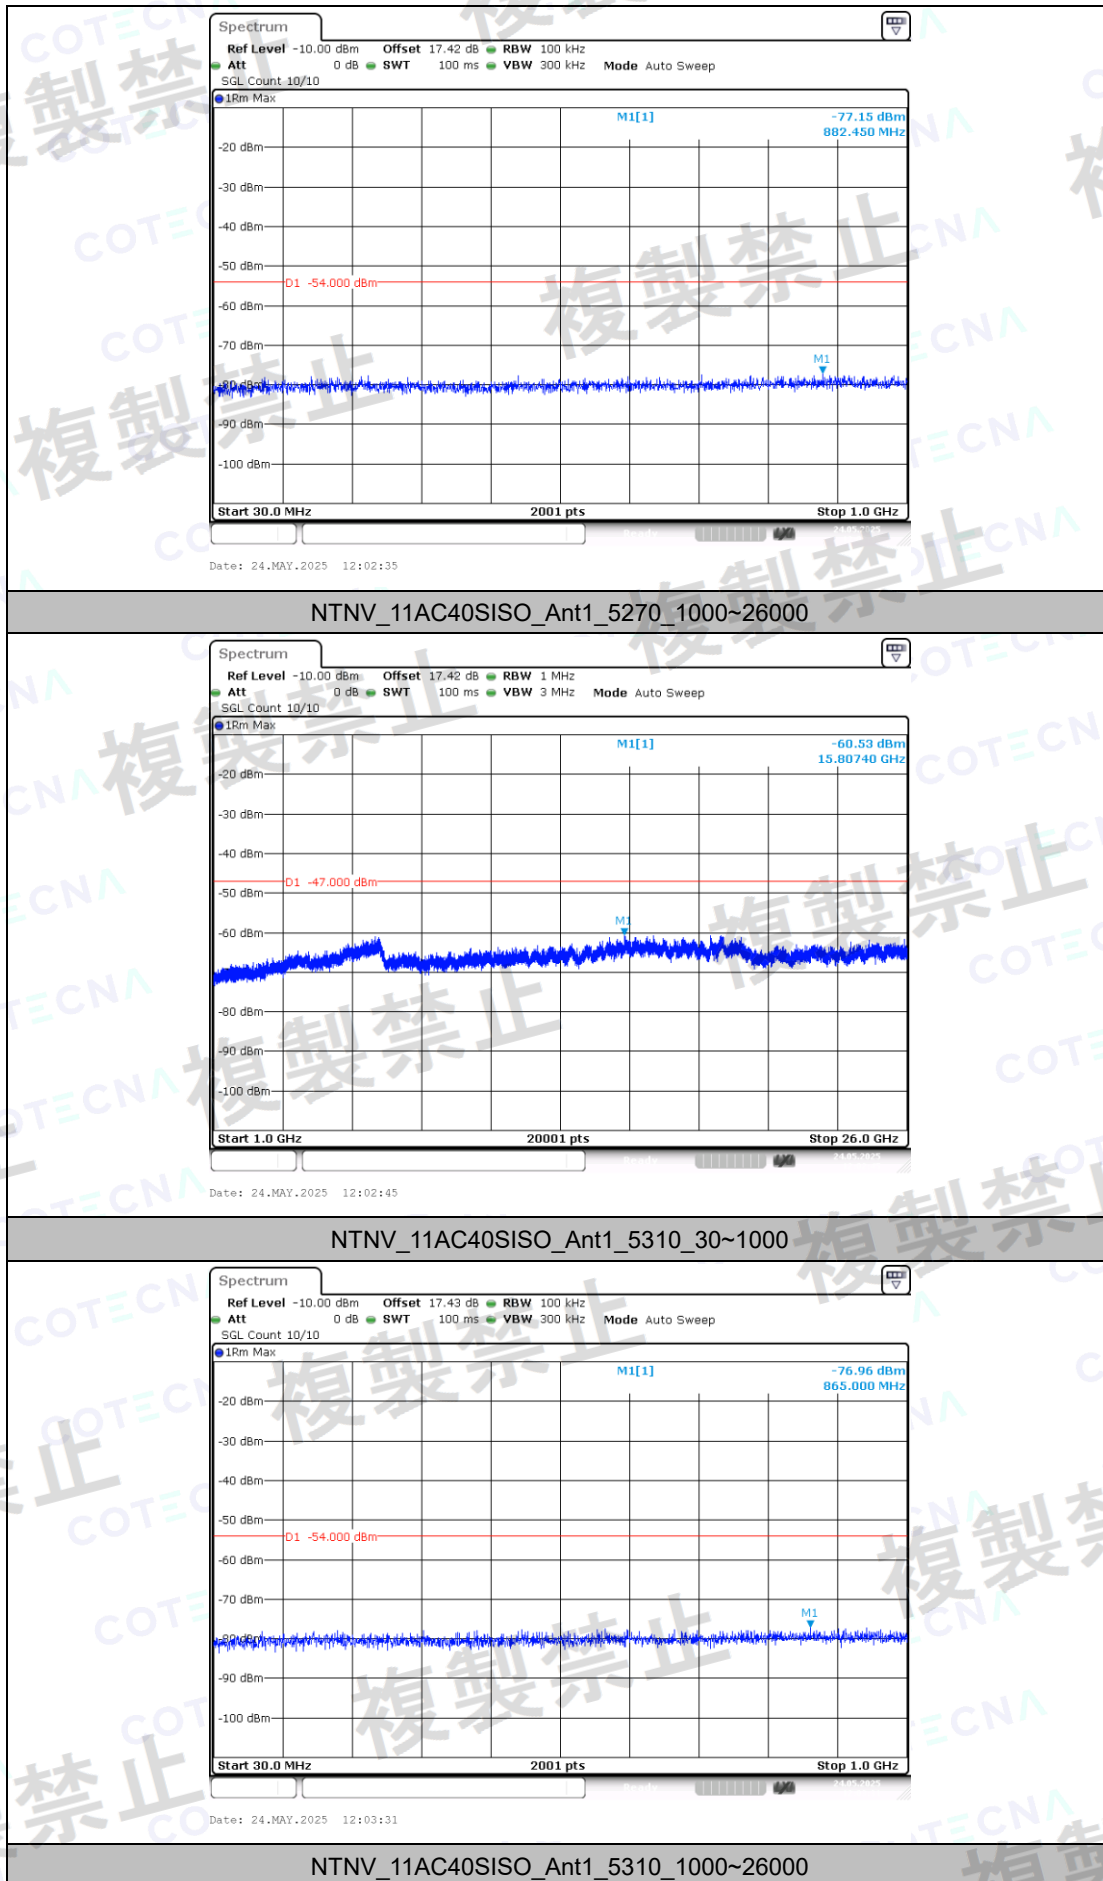


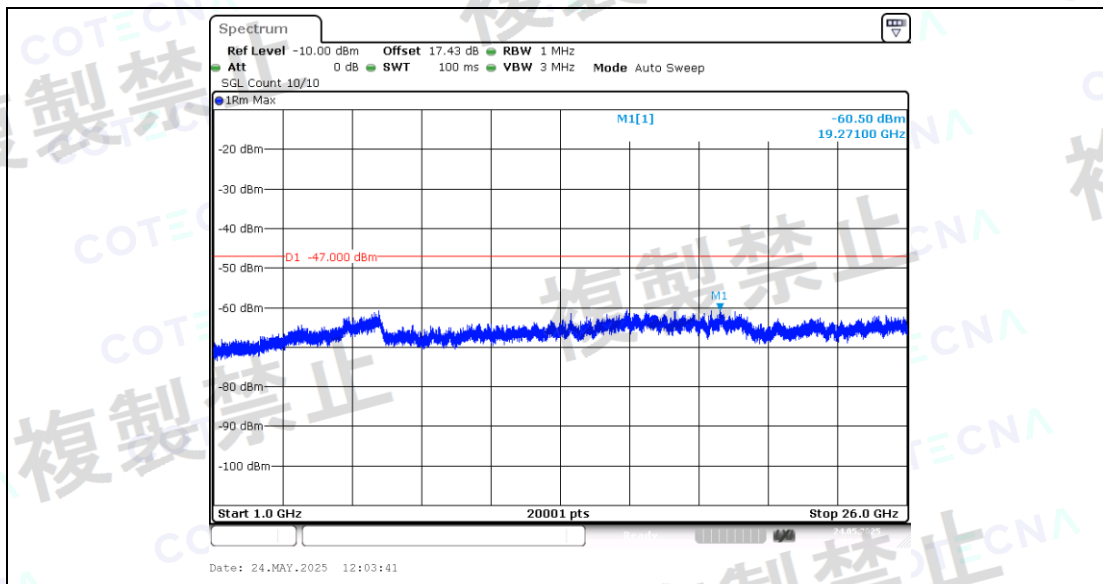

NTVN_11AC40SISO_Ant1_5510_30~1000

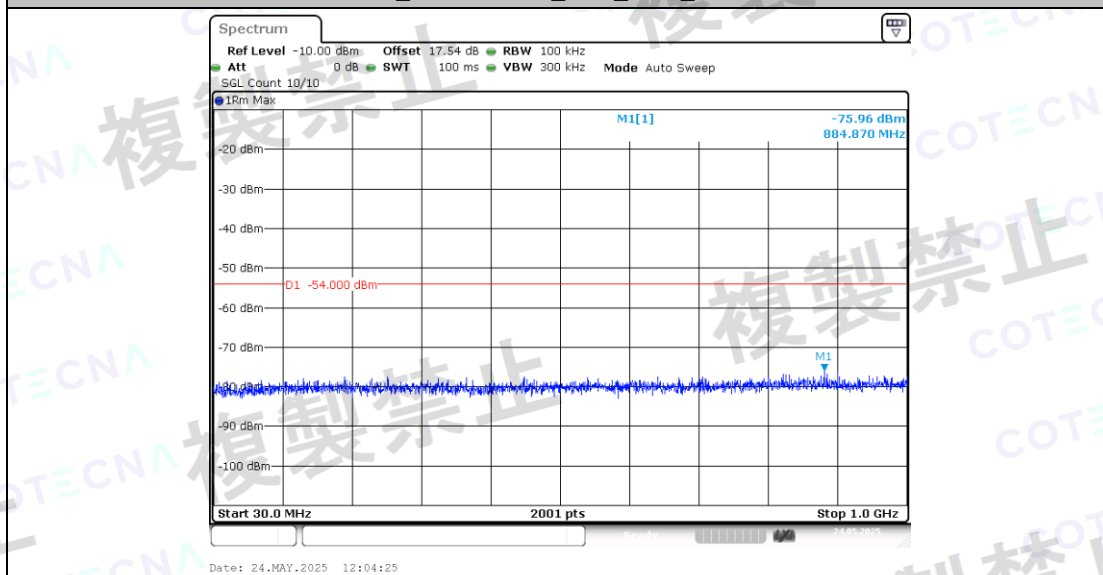



NTVN_11AC40SISO_Ant1_5510_1000~26000

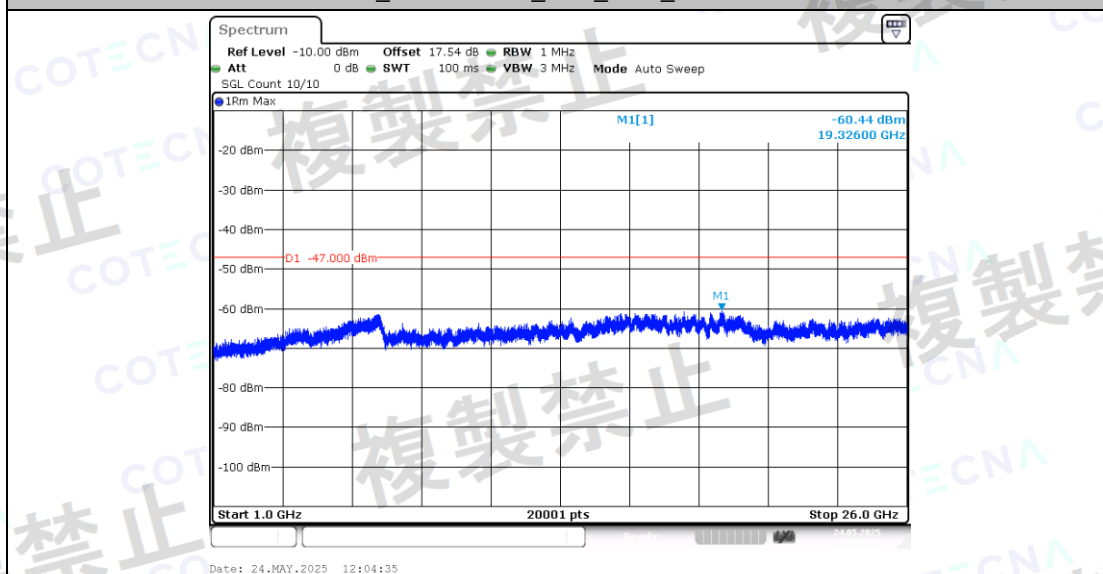


NTVN_11AC40SISO_Ant1_5550_30~1000



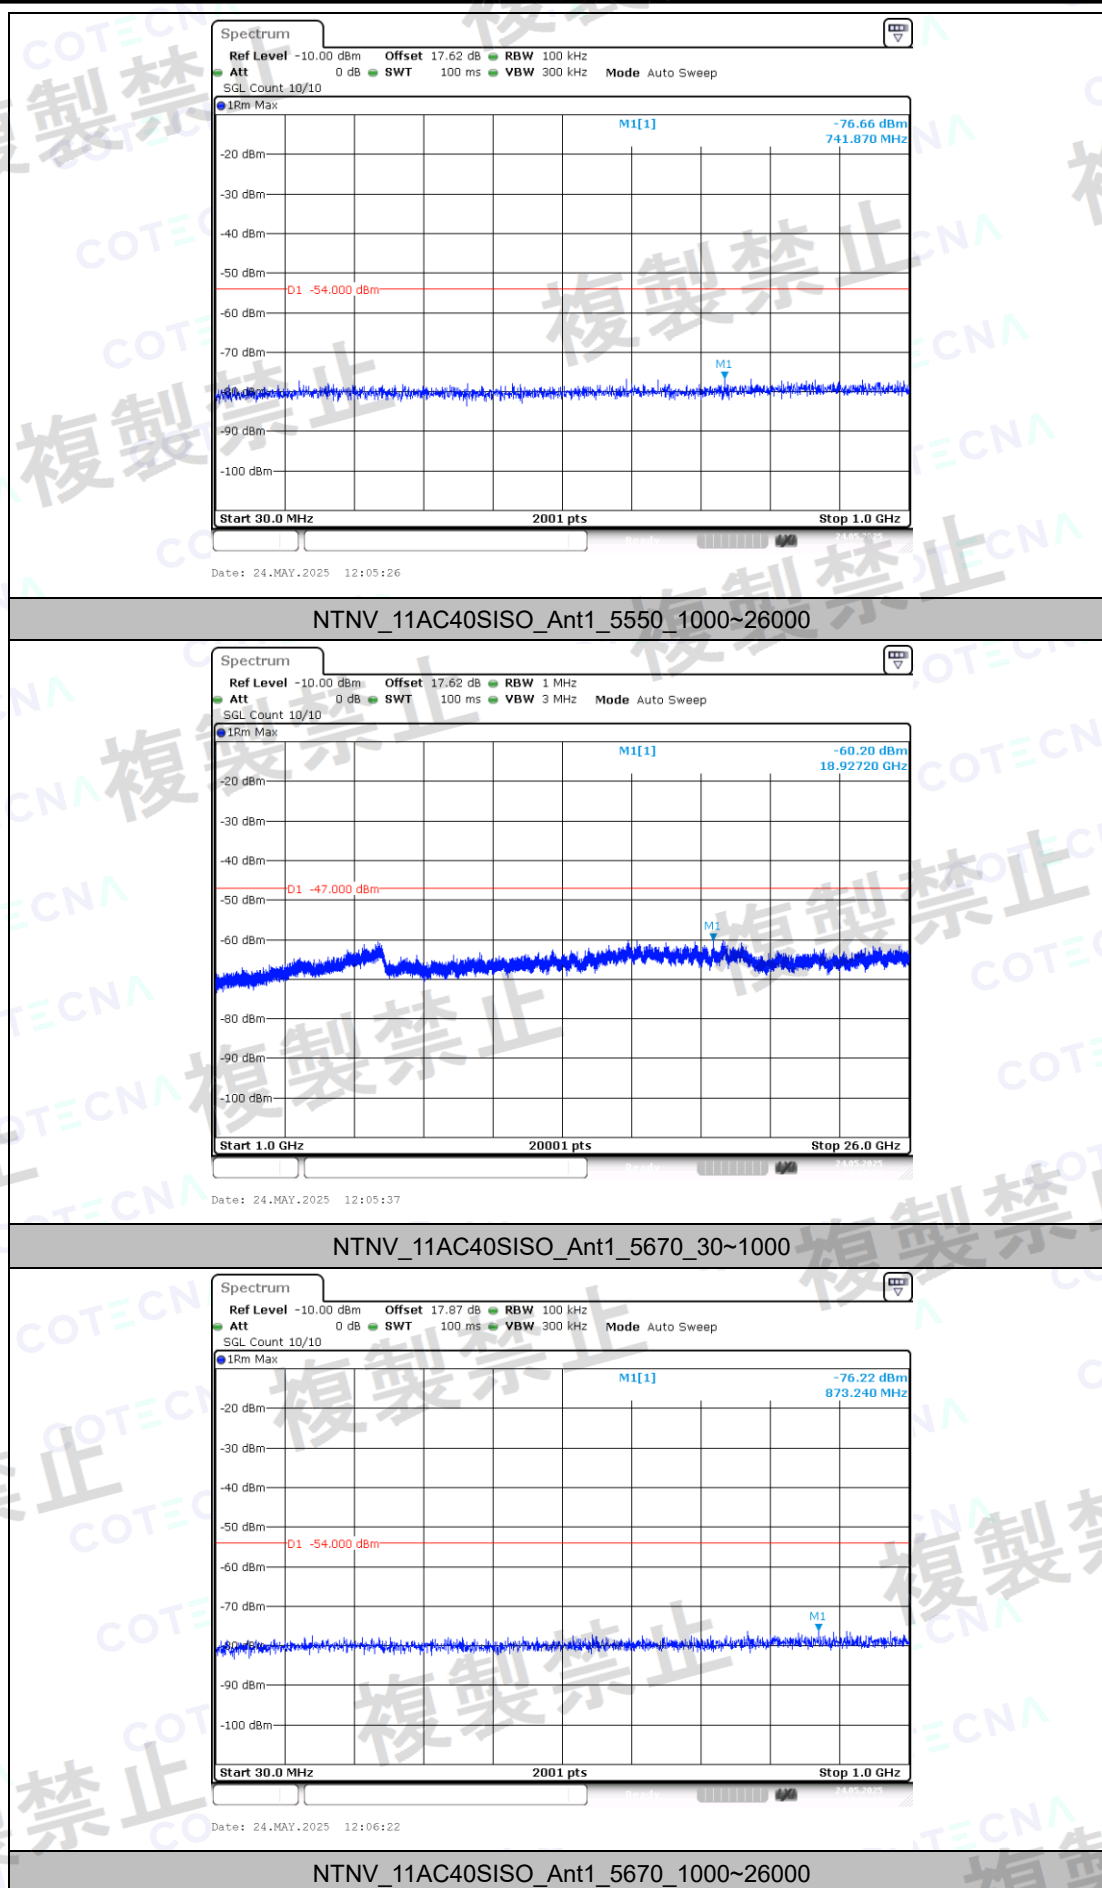


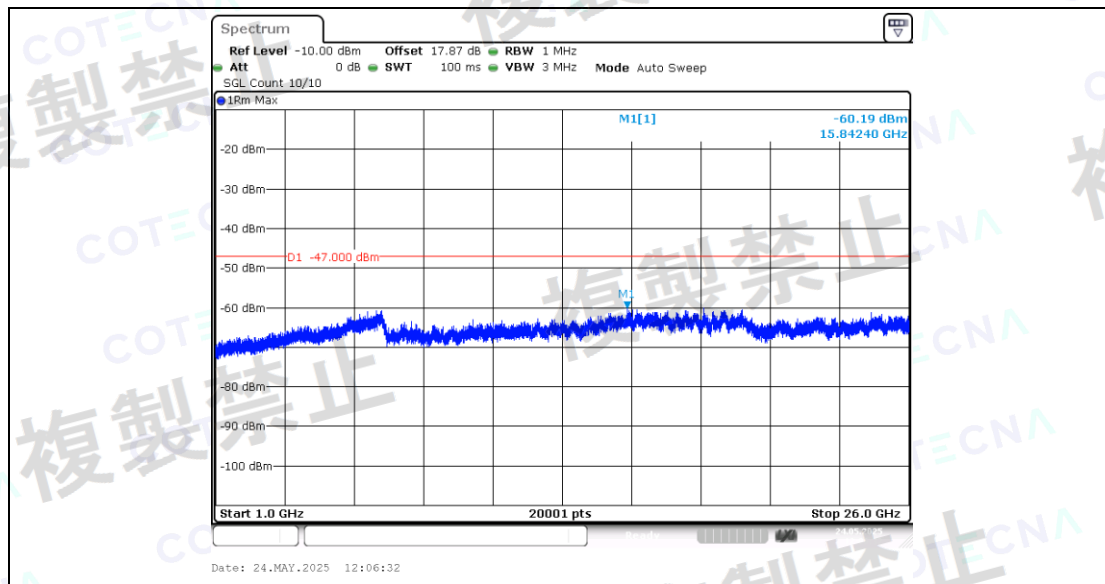

NTVN_11AC40SISO_Ant1_5710_30~1000

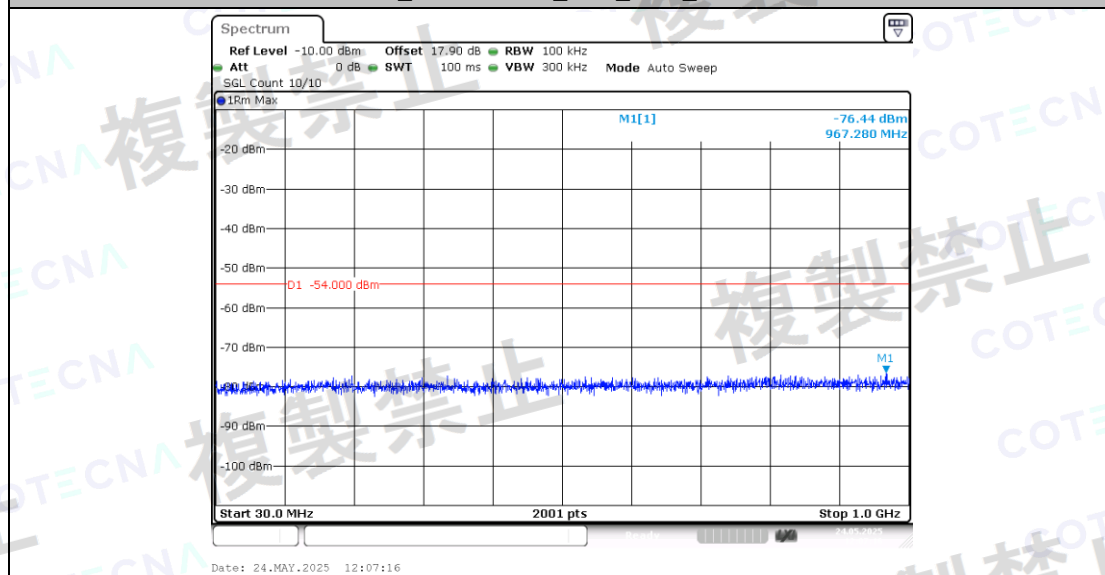


NTVN_11AC40SISO_Ant1_5710_1000~26000

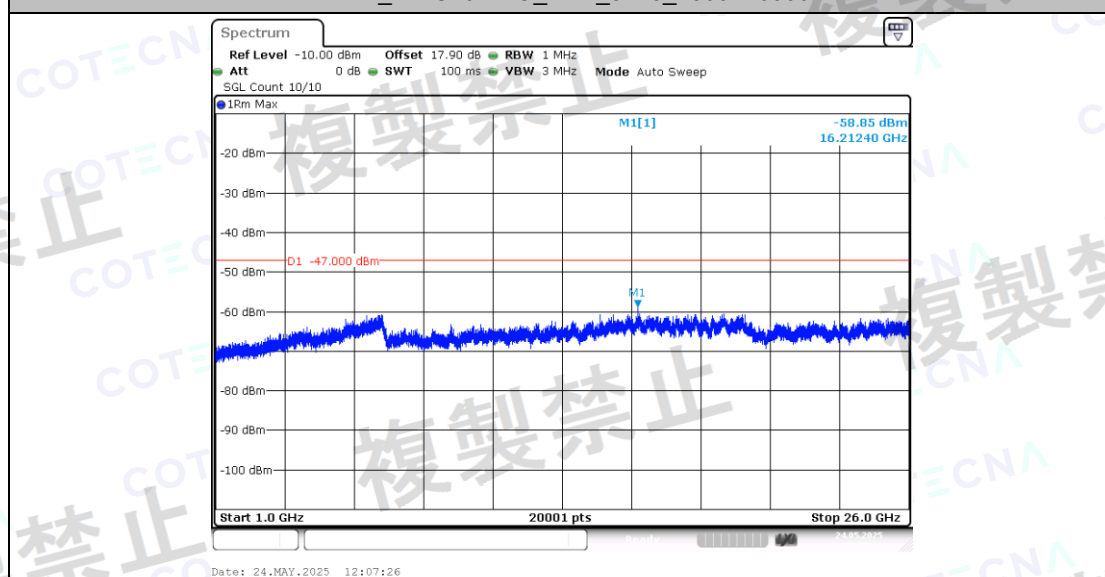


NTVN_11AC80SISO_Ant1_5210_30~1000






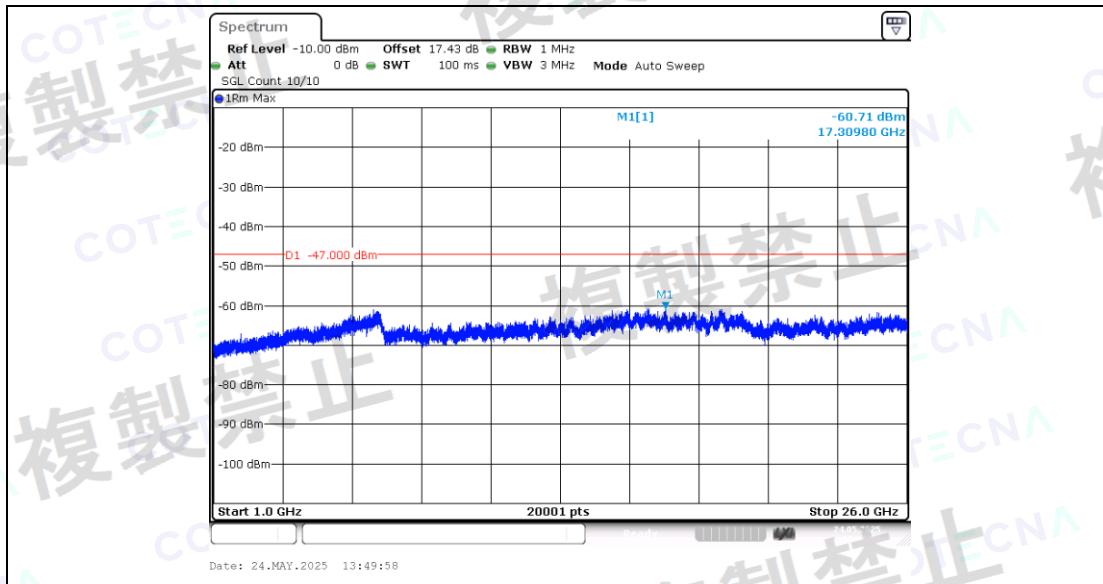

NTVN_11AC80SISO_Ant1_5530_30~1000

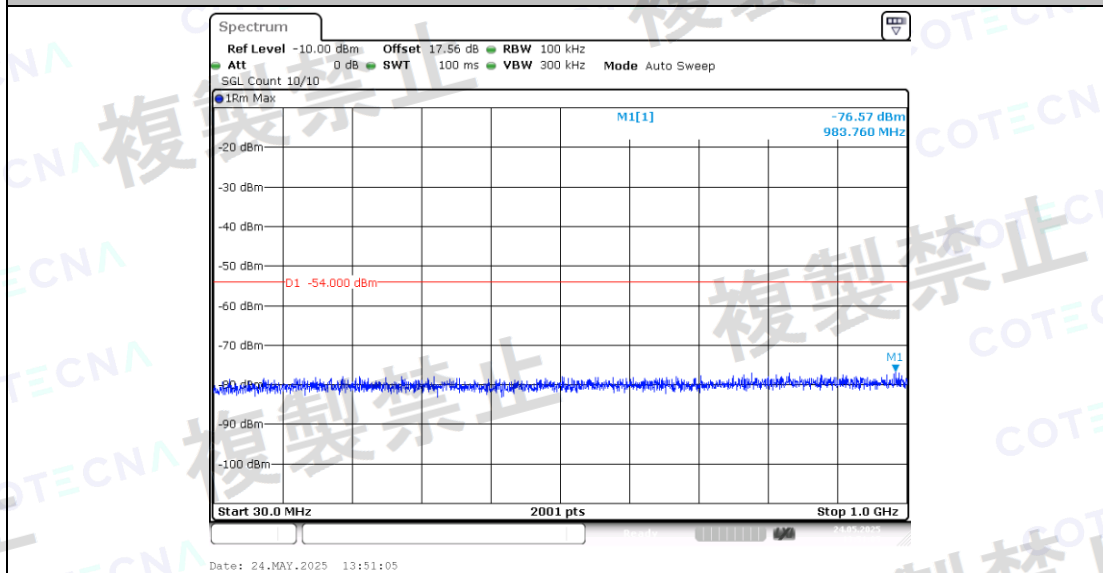



NTVN_11AC80SISO_Ant1_5530_1000~26000

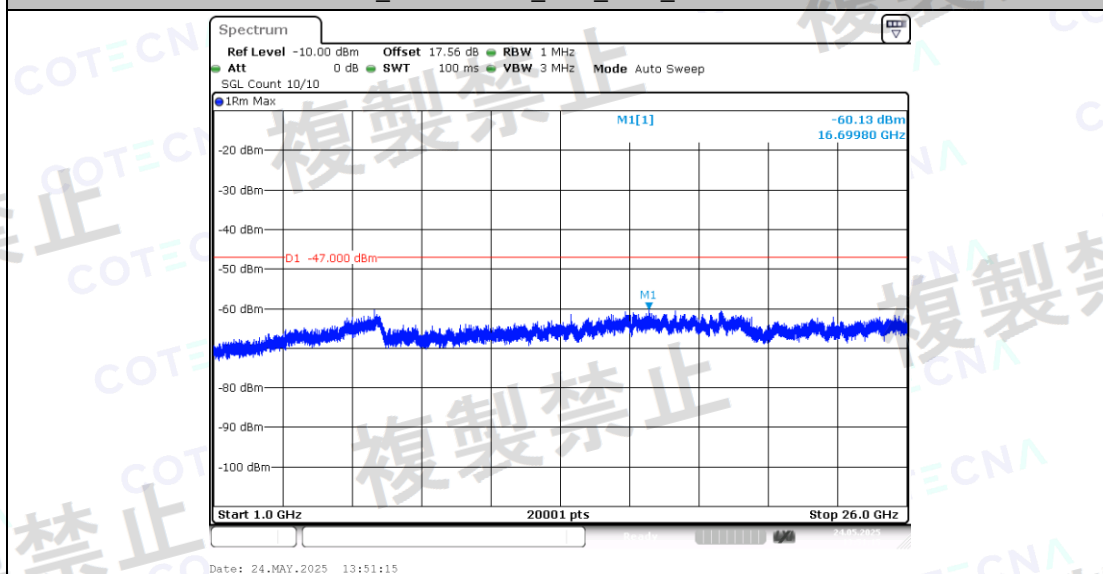


NTVN_11AC80SISO_Ant1_5610_30~1000



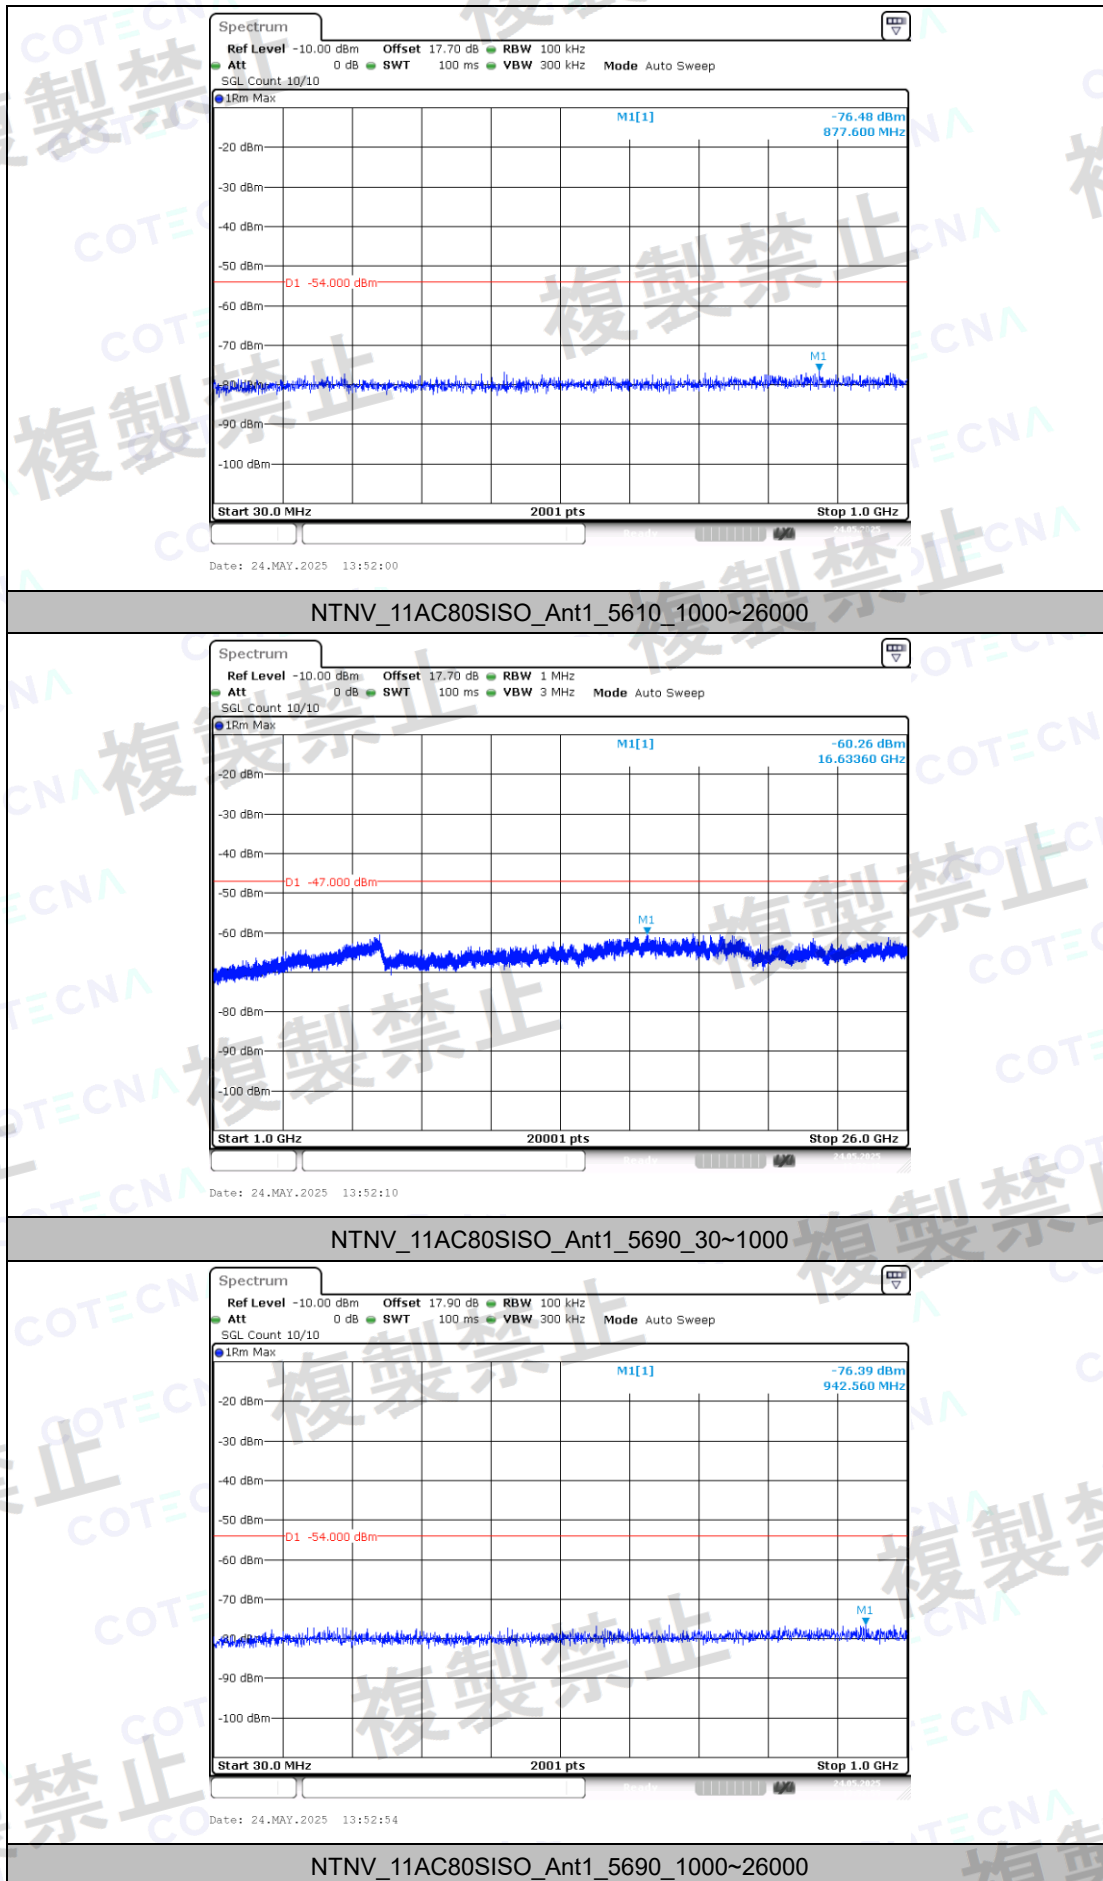


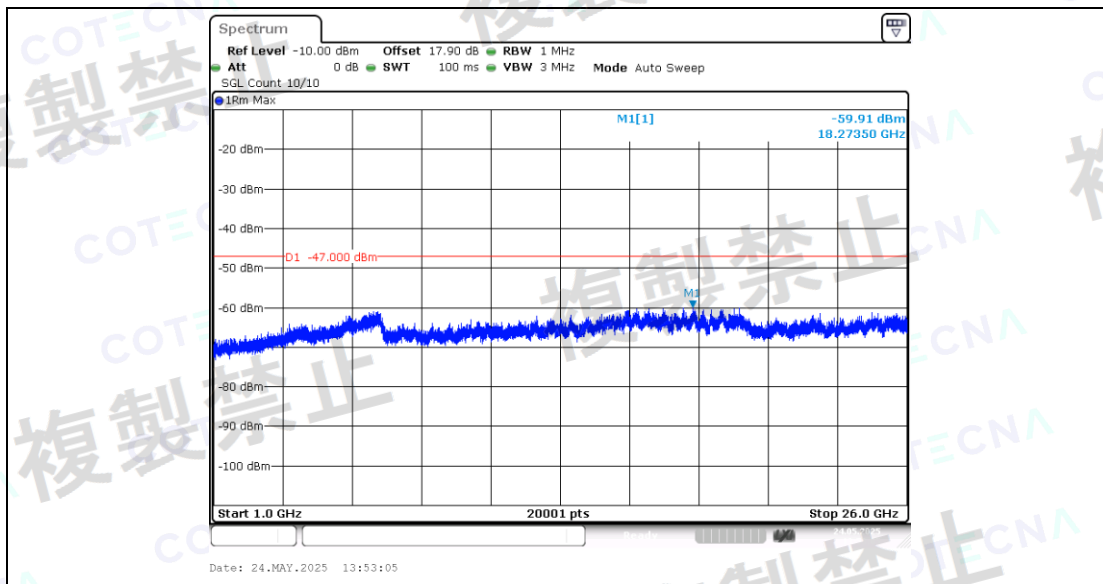

NTNV_11AX20SISO_Ant1_5180_30~1000

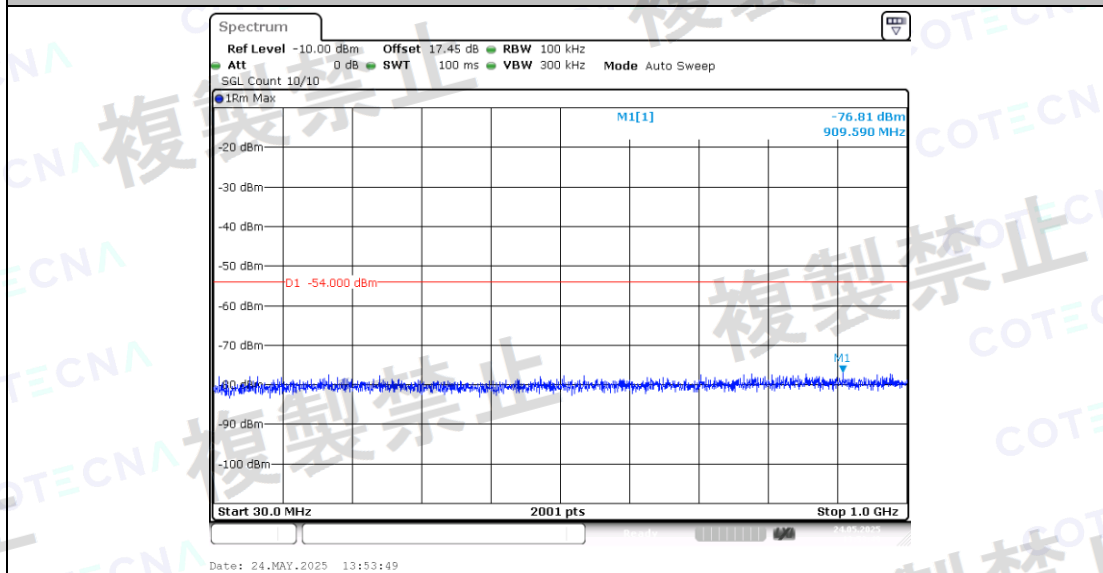


NTNV_11AX20SISO_Ant1_5180_1000~26000

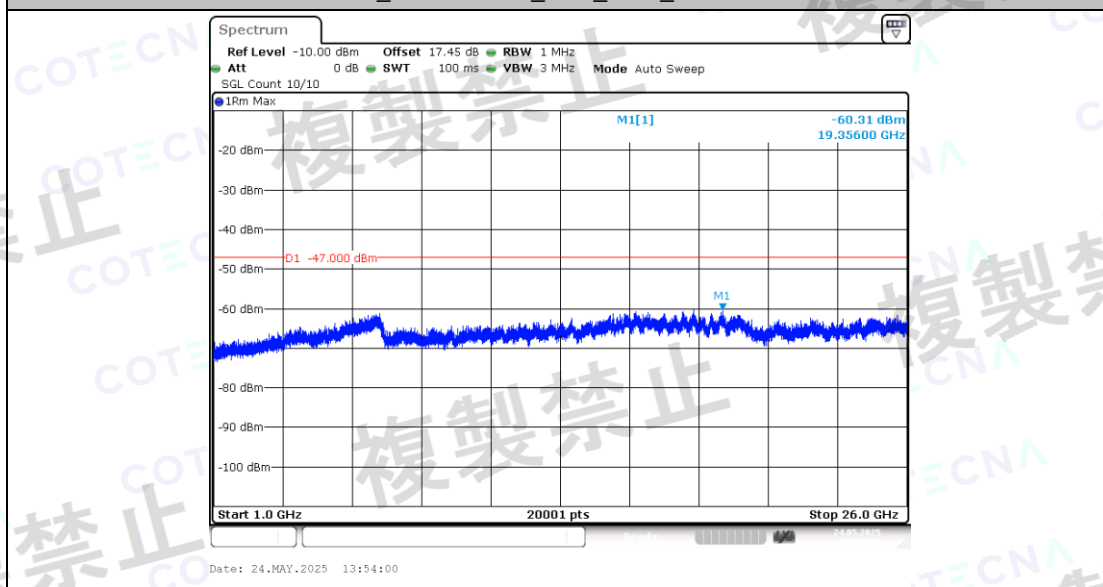


NTNV_11AX20SISO_Ant1_5200_30~1000






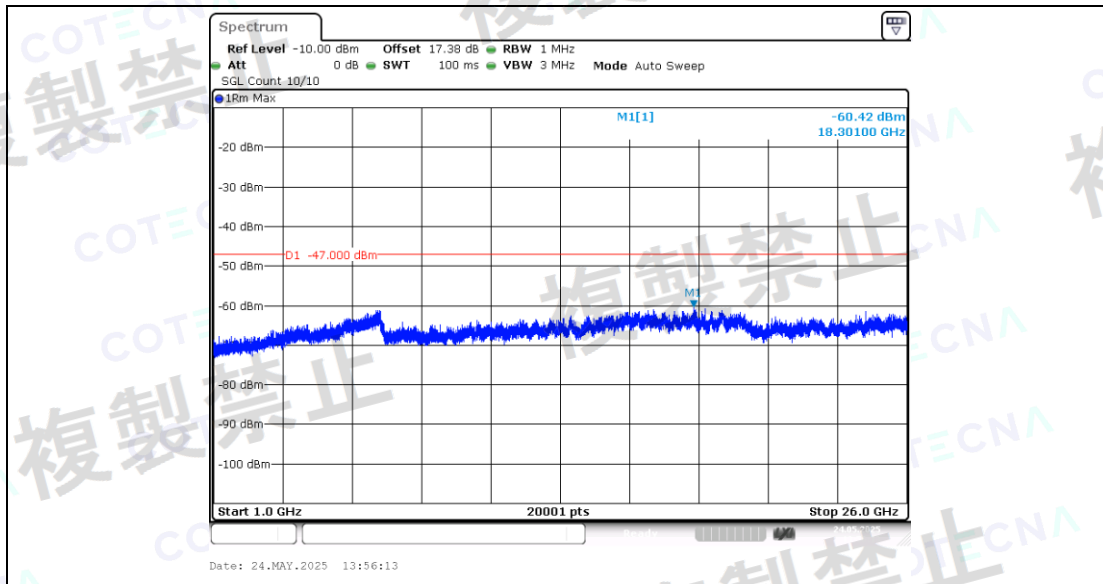

NTNV_11AX20SISO_Ant1_5240_30~1000

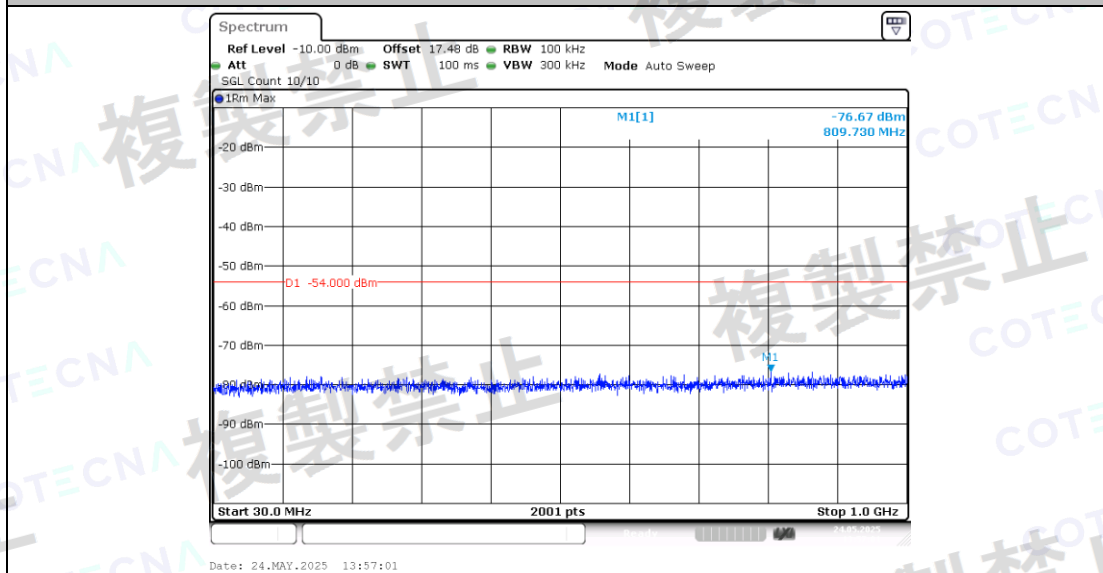



NTNV_11AX20SISO_Ant1_5240_1000~26000

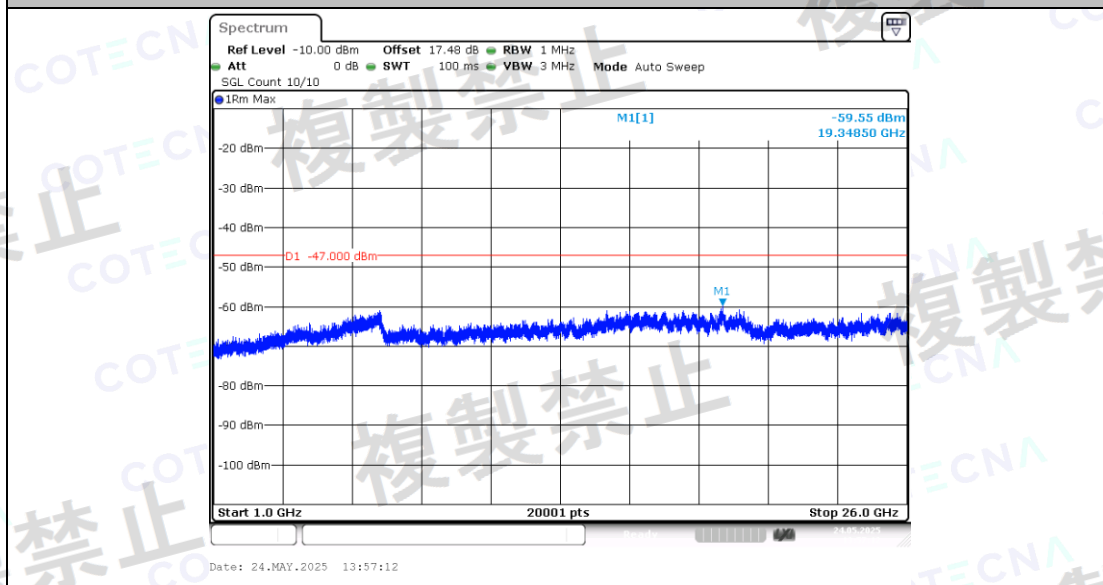


NTNV_11AX20SISO_Ant1_5260_30~1000



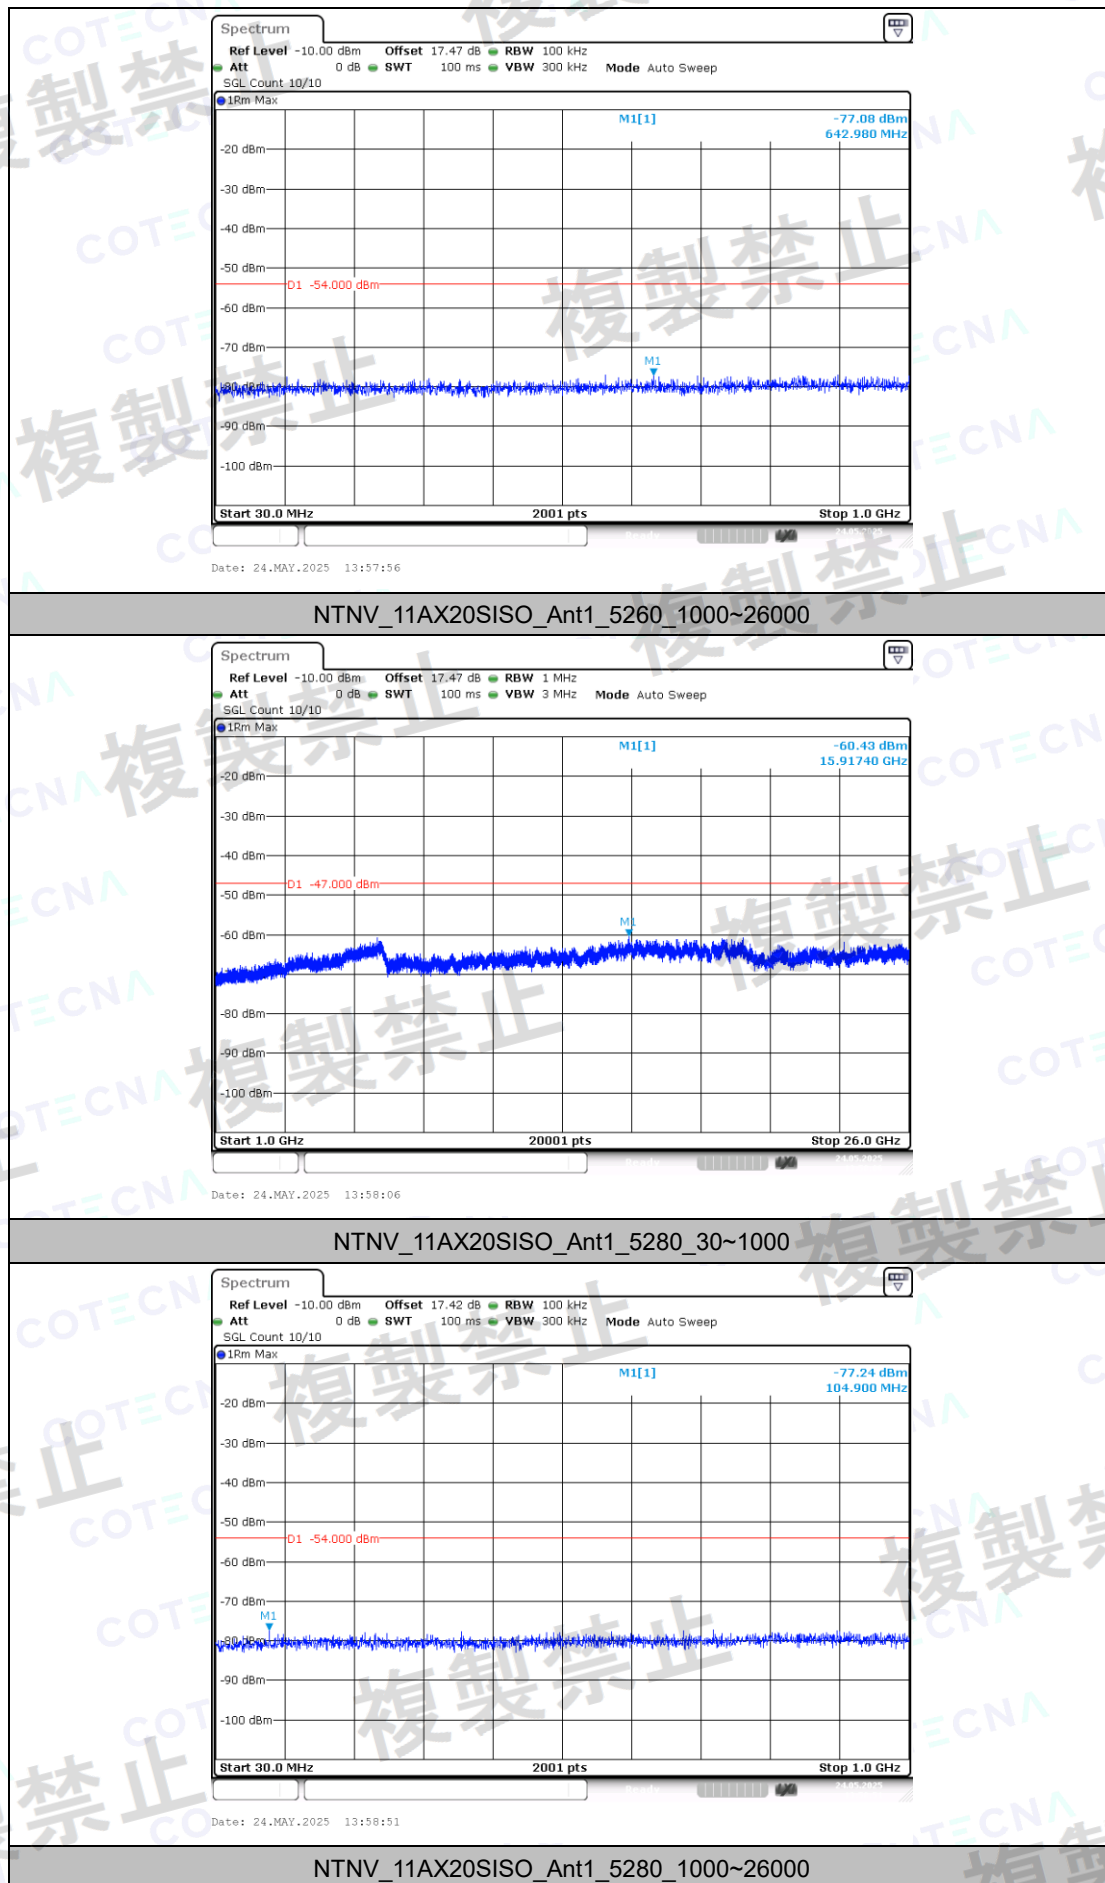


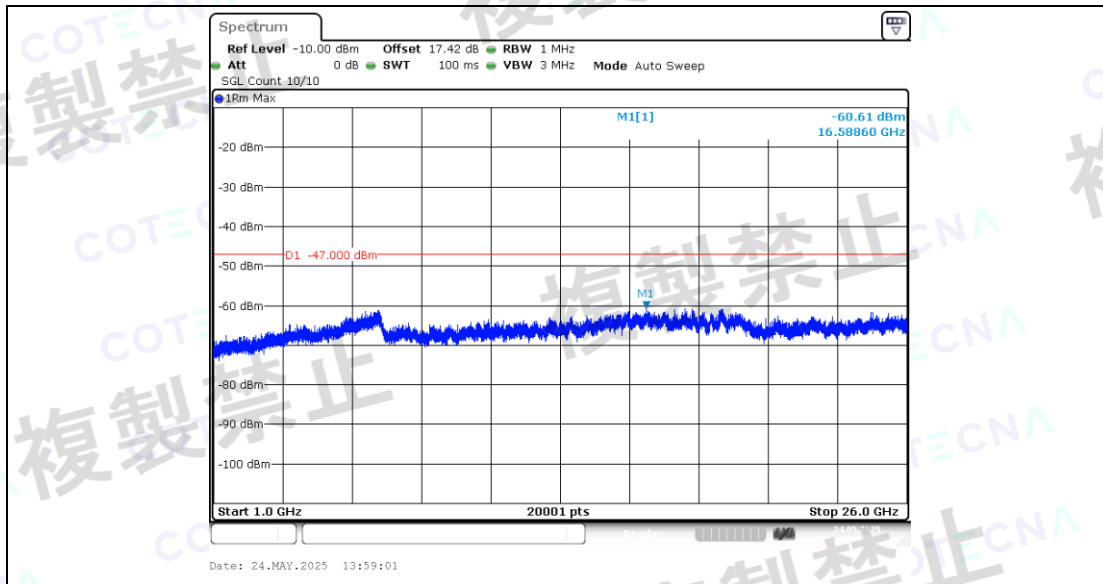

NTNV_11AX20SISO_Ant1_5300_30~1000

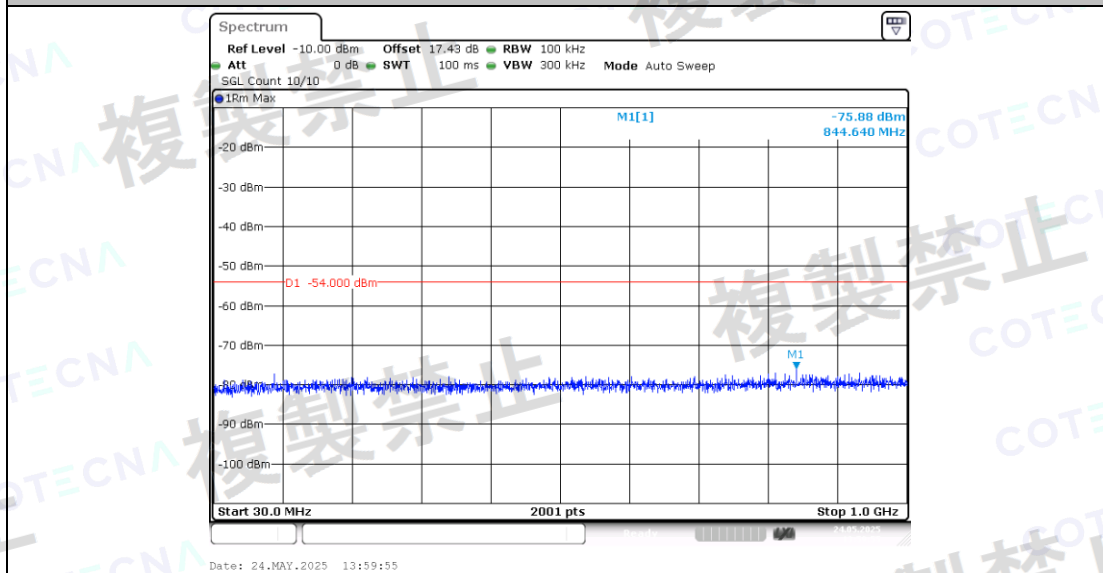



NTNV_11AX20SISO_Ant1_5300_1000~26000

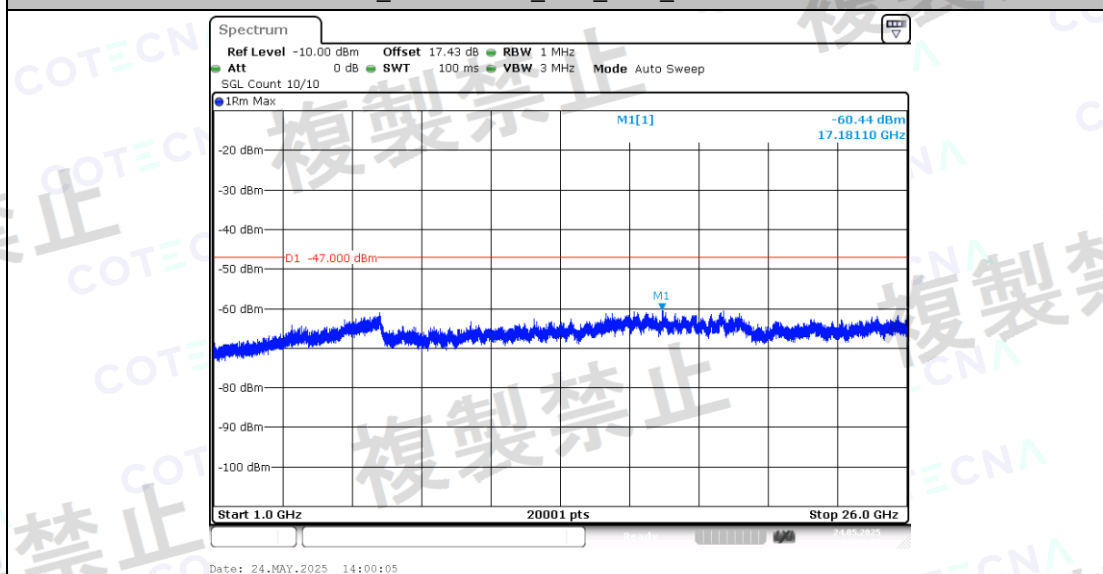


NTNV_11AX20SISO_Ant1_5320_30~1000



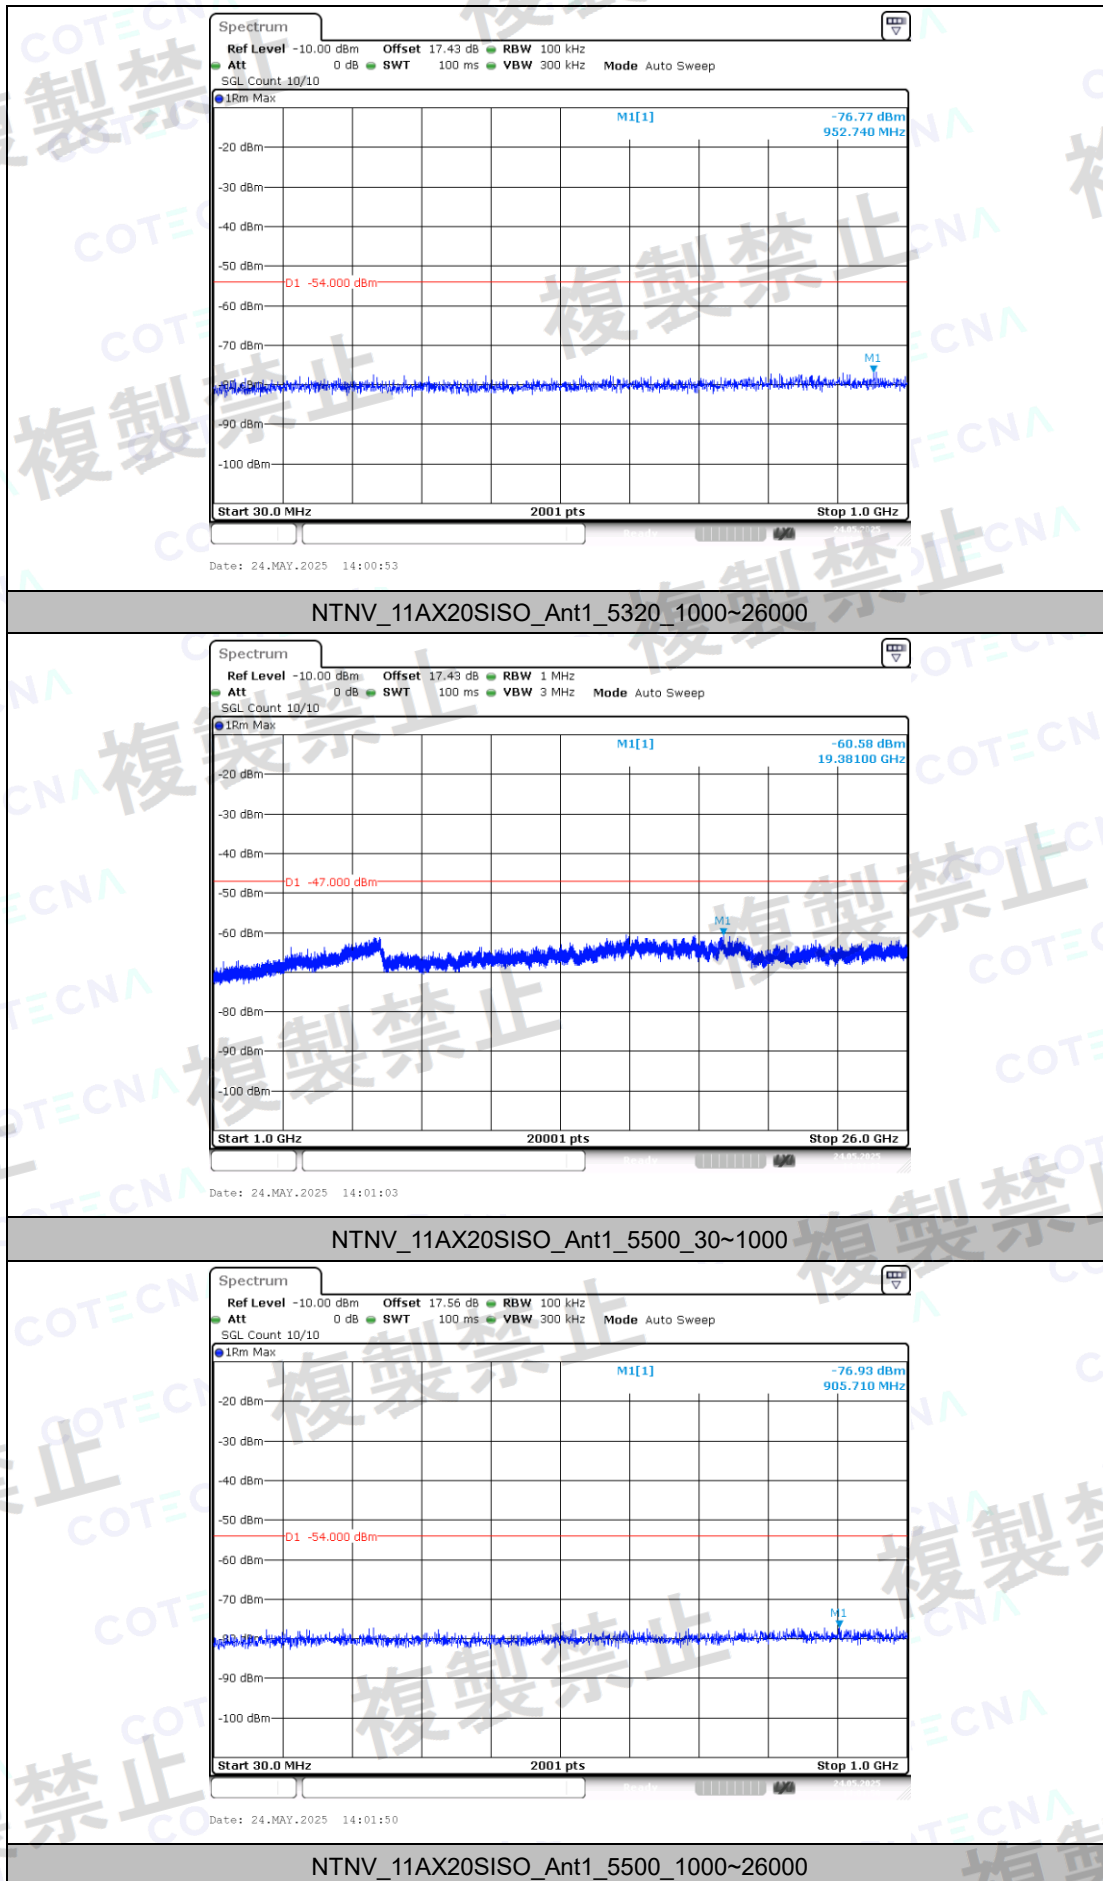


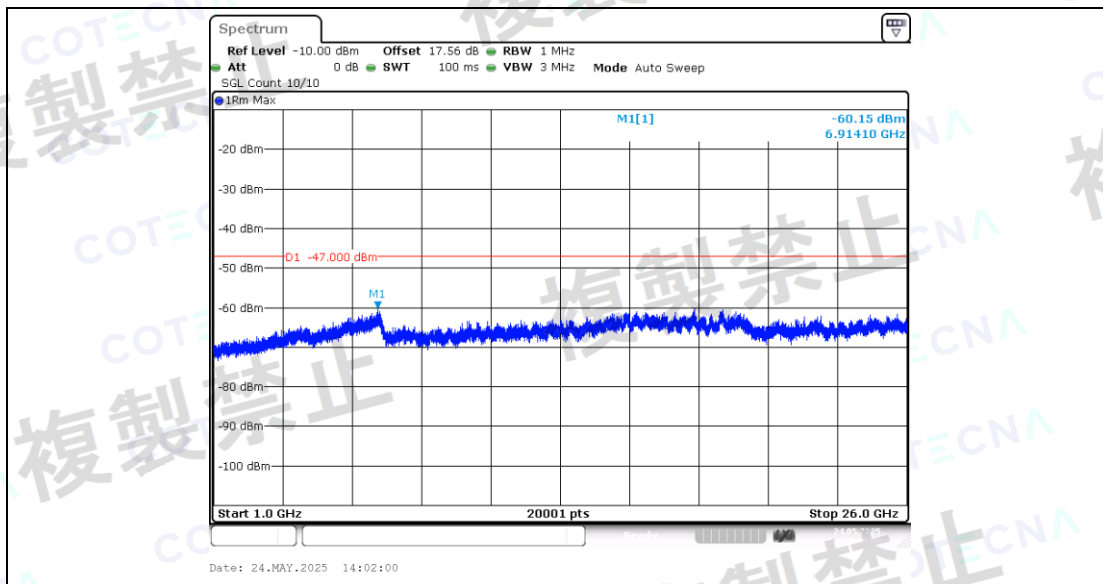

NTVN_11AX20SISO_Ant1_5580_30~1000

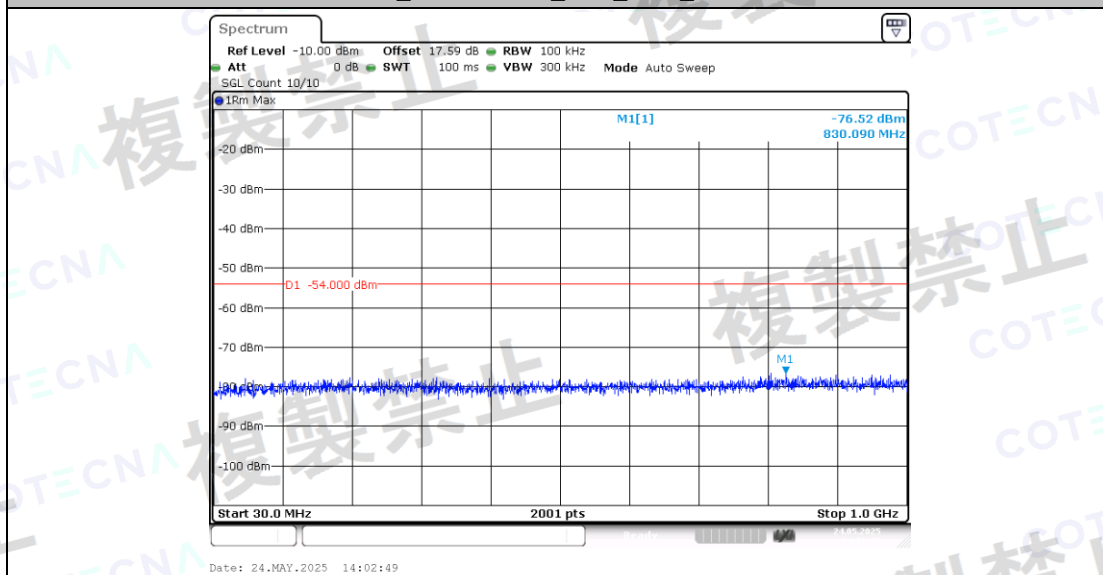


NTVN_11AX20SISO_Ant1_5580_1000~26000

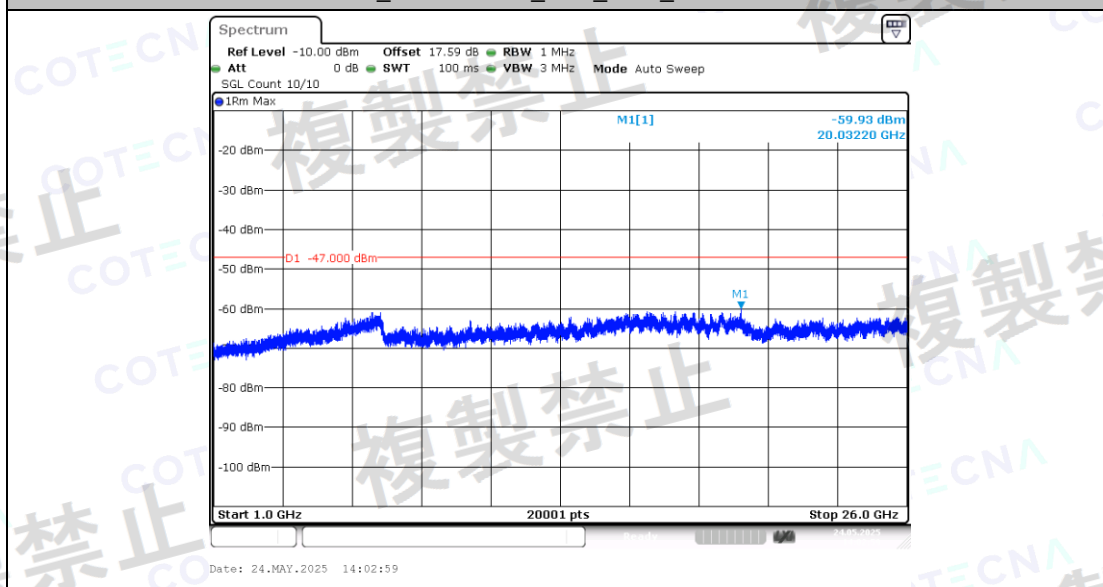


NTVN_11AX20SISO_Ant1_5600_30~1000






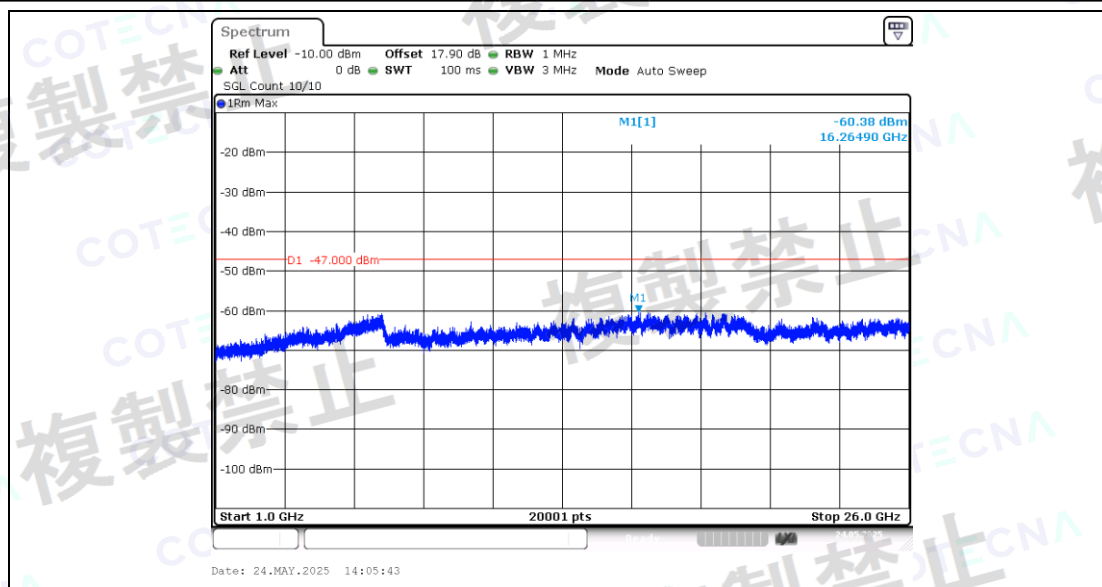

NTVN_11AX20SISO_Ant1_5720_30~1000

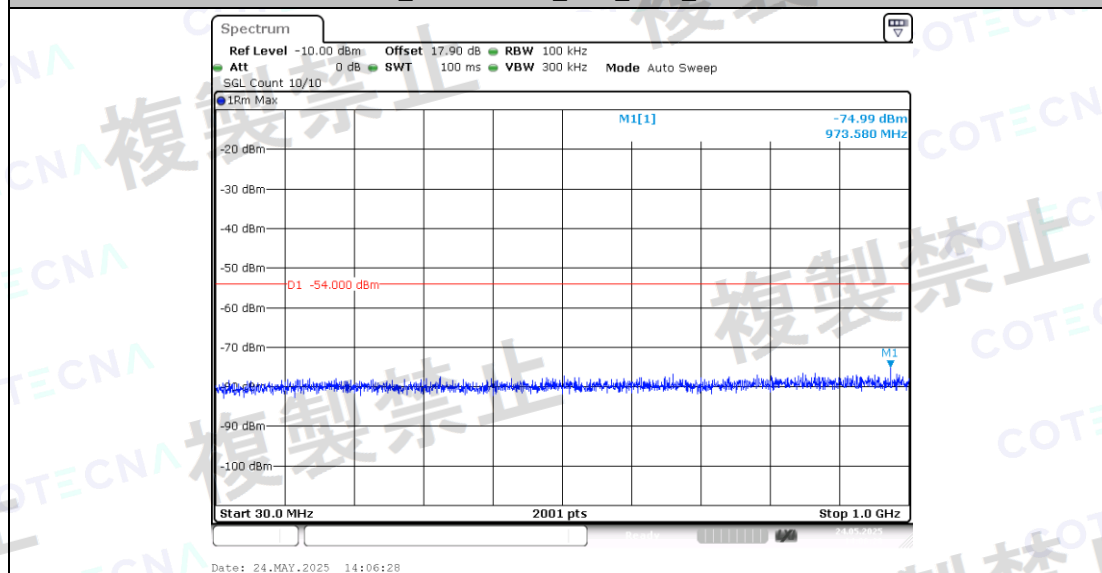



NTVN_11AX20SISO_Ant1_5720_1000~26000

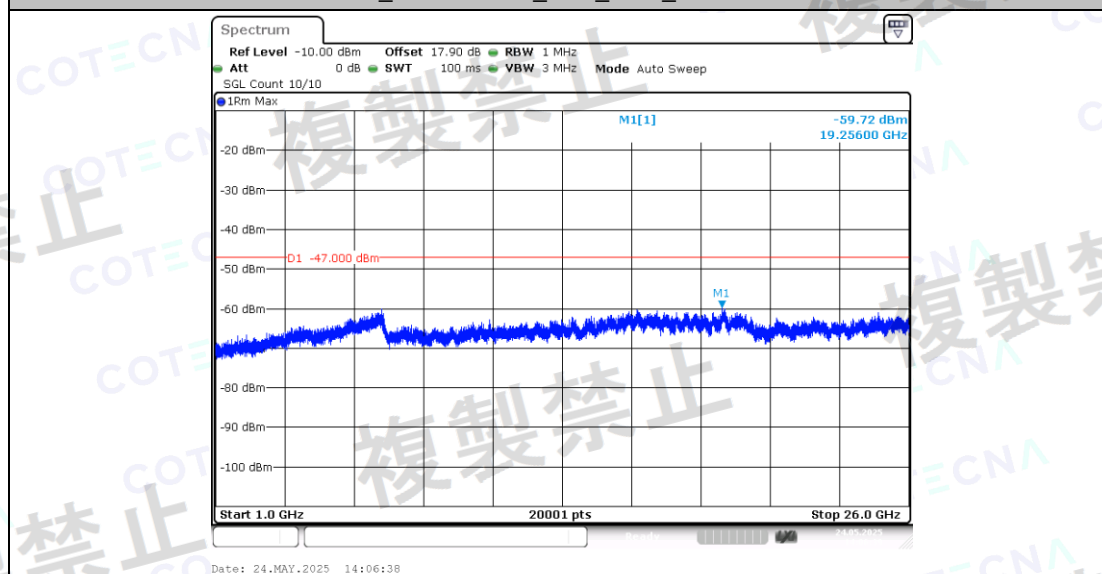


NTVN_11AX40SISO_Ant1_5190_30~1000



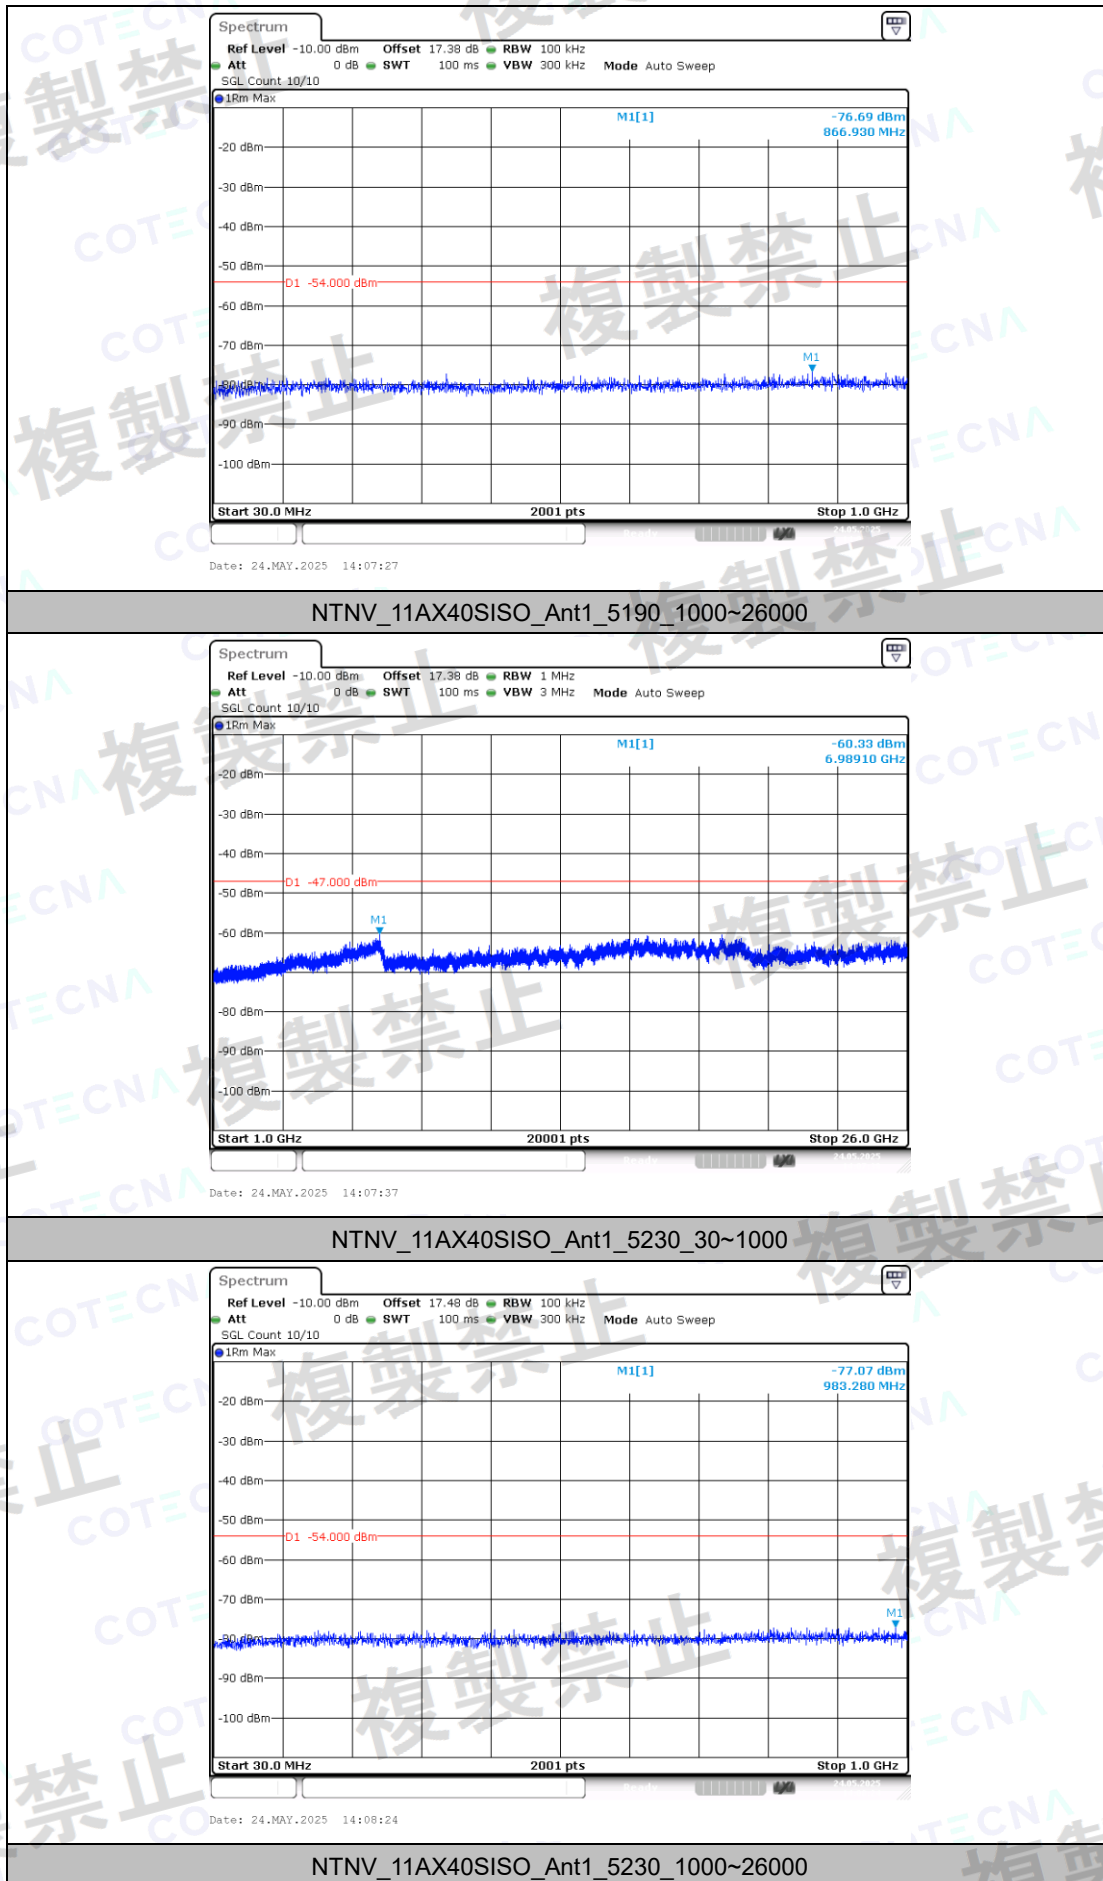


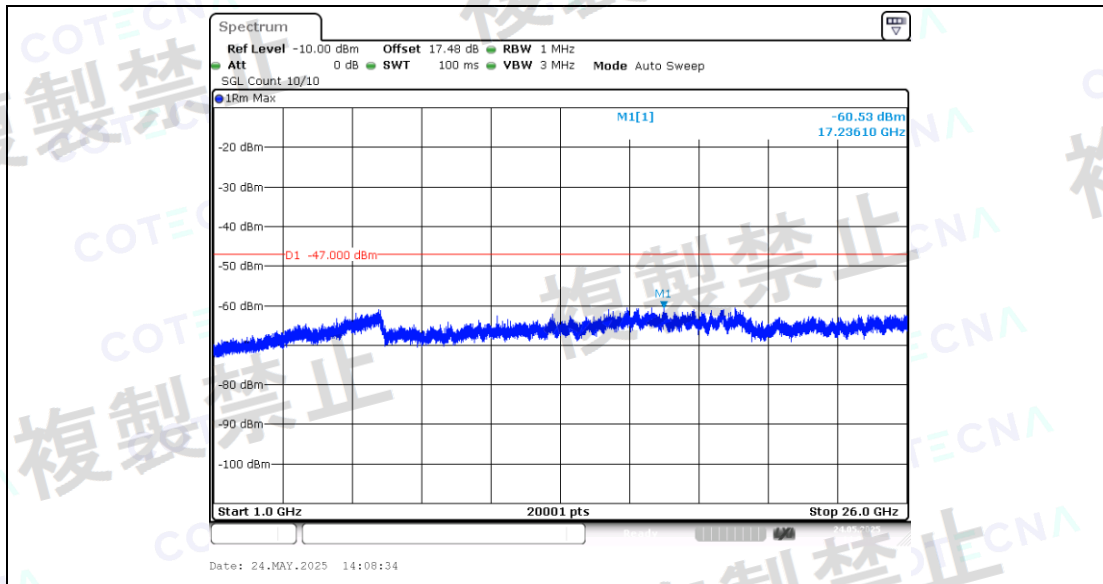

NTNV_11AX40SISO_Ant1_5270_30~1000

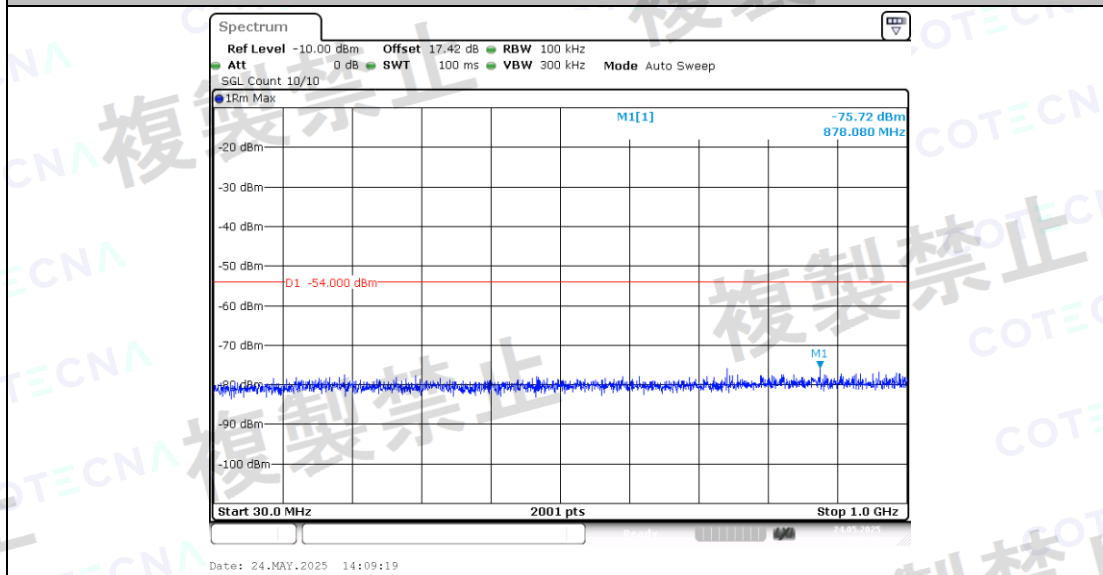

NTNV_11AX40SISO_Ant1_5270_1000~26000

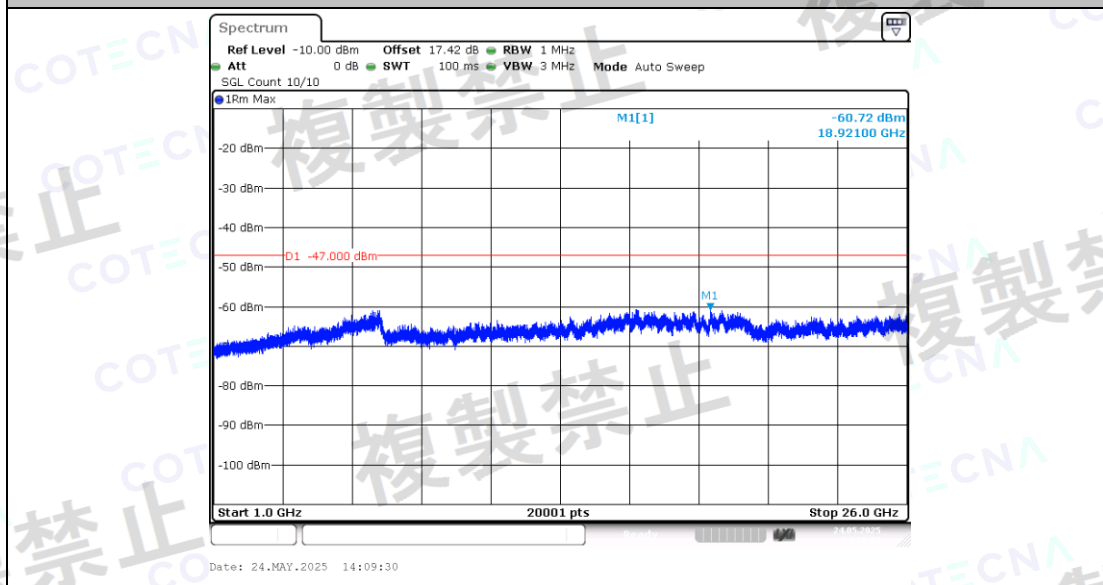

NTNV_11AX40SISO_Ant1_5310_30~1000



