


Appendix Test Data

Report No.:	1812C60241712501-01	Test Sample No.:	1-2-2
Start Test Date:	2026-4-29	Finish Test Date:	2026-4-30
Test Engineer:	Tracy Liang	Auditor:	Justin Feng
Temperature:	23.1°C	Relative Humidity:	54.2%
Pressure:	101kPa		

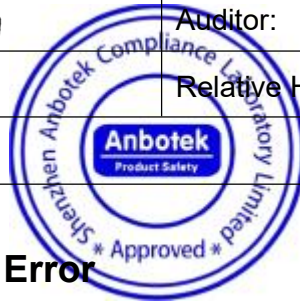

Appendix A: Frequency Error


Test Result

Test Condition	Test Mode	Antenna	Freq.[MHz]	Center Freq [MHz]	Result[ppm]	Limit[ppm]	Verdict
NTNV	CW	Ant1	2402	2401.999	-0.41632	±50	PASS
NTNV	CW	Ant1	2440	2439.999	-0.40984	±50	PASS
NTNV	CW	Ant1	2480	2479.9985	-0.60484	±50	PASS

Note: Result[ppm]= (Center Freq[MHz] -Freq.[MHz])/Freq.[MHz]*1000000



Test Graphs

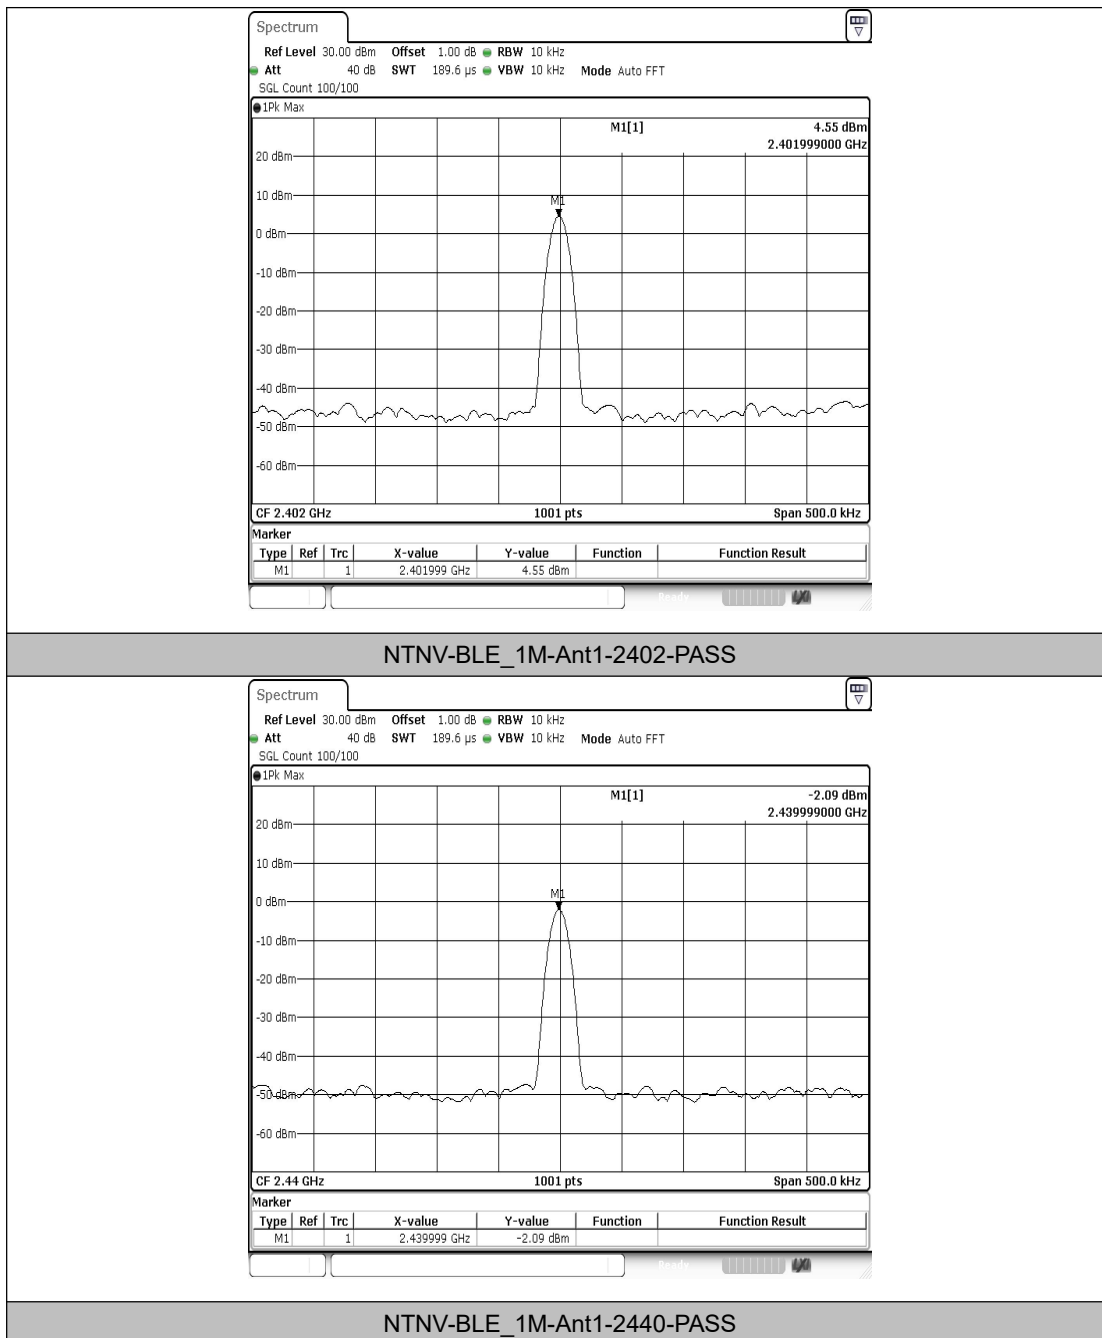


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



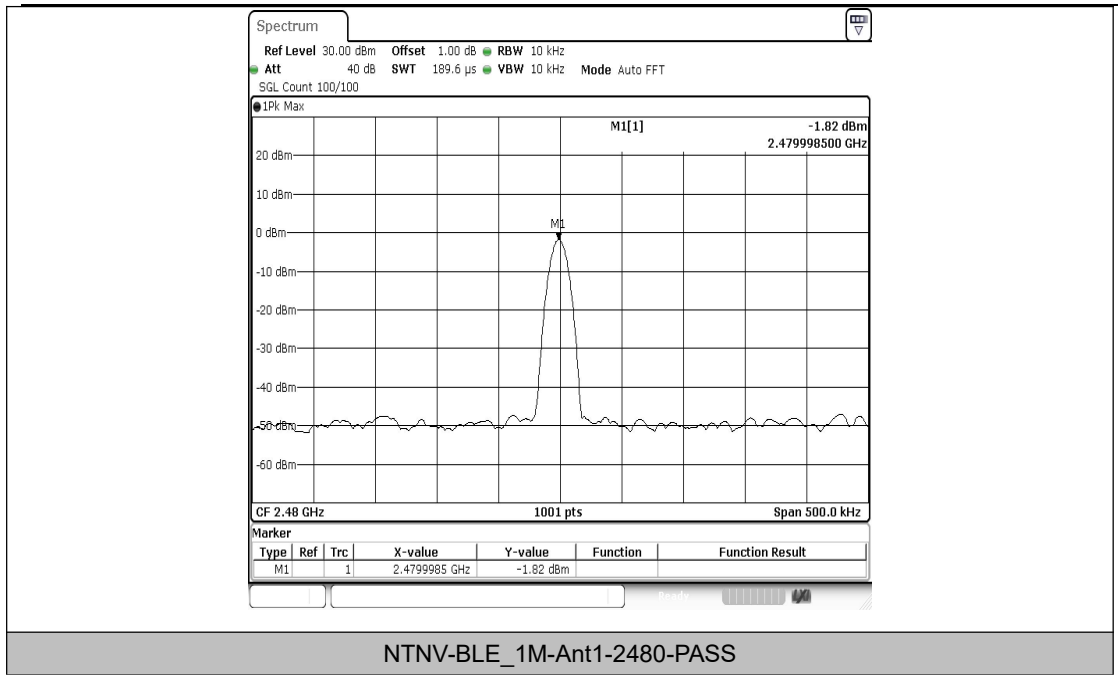

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



Appendix B: Antenna Power

Test Result

Test Condition	TestMode	Antenna	Freq. [MHz]	Result[dBm]	Result[mW]	Limit [mW]	Verdict
NTNV	BLE_1M	Ant1	2402	6.09	4.0644	≤10	PASS
NTNV	BLE_1M	Ant1	2440	6.27	4.2364	≤10	PASS
NTNV	BLE_1M	Ant1	2480	6.80	4.7863	≤10	PASS

Note: Result(mW)= $10^{(\text{Test Result(dBm)}/10)}$


Test Condition	Test Mode	Antenna	Freq. [MHz]	Power [mW]	Rated Power [mW]	Result [%]	Limit(%)	Verdict
NTNV	BLE_1M	Ant1	2402	4.0644	5	-18.71	+20	PASS
NTNV	BLE_1M	Ant1	2440	4.2364	5	-15.27	+20	PASS
NTNV	BLE_1M	Ant1	2480	4.7863	5	-4.27	+20	PASS

Test Condition	Test Mode	Antenna	Frequency [MHz]	Result[dBm]	Gain[dBi]	EIRP(dBm)	Limit(dBm)	Verdict
NTNV	BLE_1M	Ant1	2402	6.09	4.04	10.13	≤12.14	PASS
NTNV	BLE_1M	Ant1	2440	6.27	4.04	10.31	≤12.14	PASS
NTNV	BLE_1M	Ant1	2480	6.80	4.04	10.84	≤12.14	PASS

Note: EIRP[dBm]=Result[dBm]+Gain(dBi)



Test Graphs

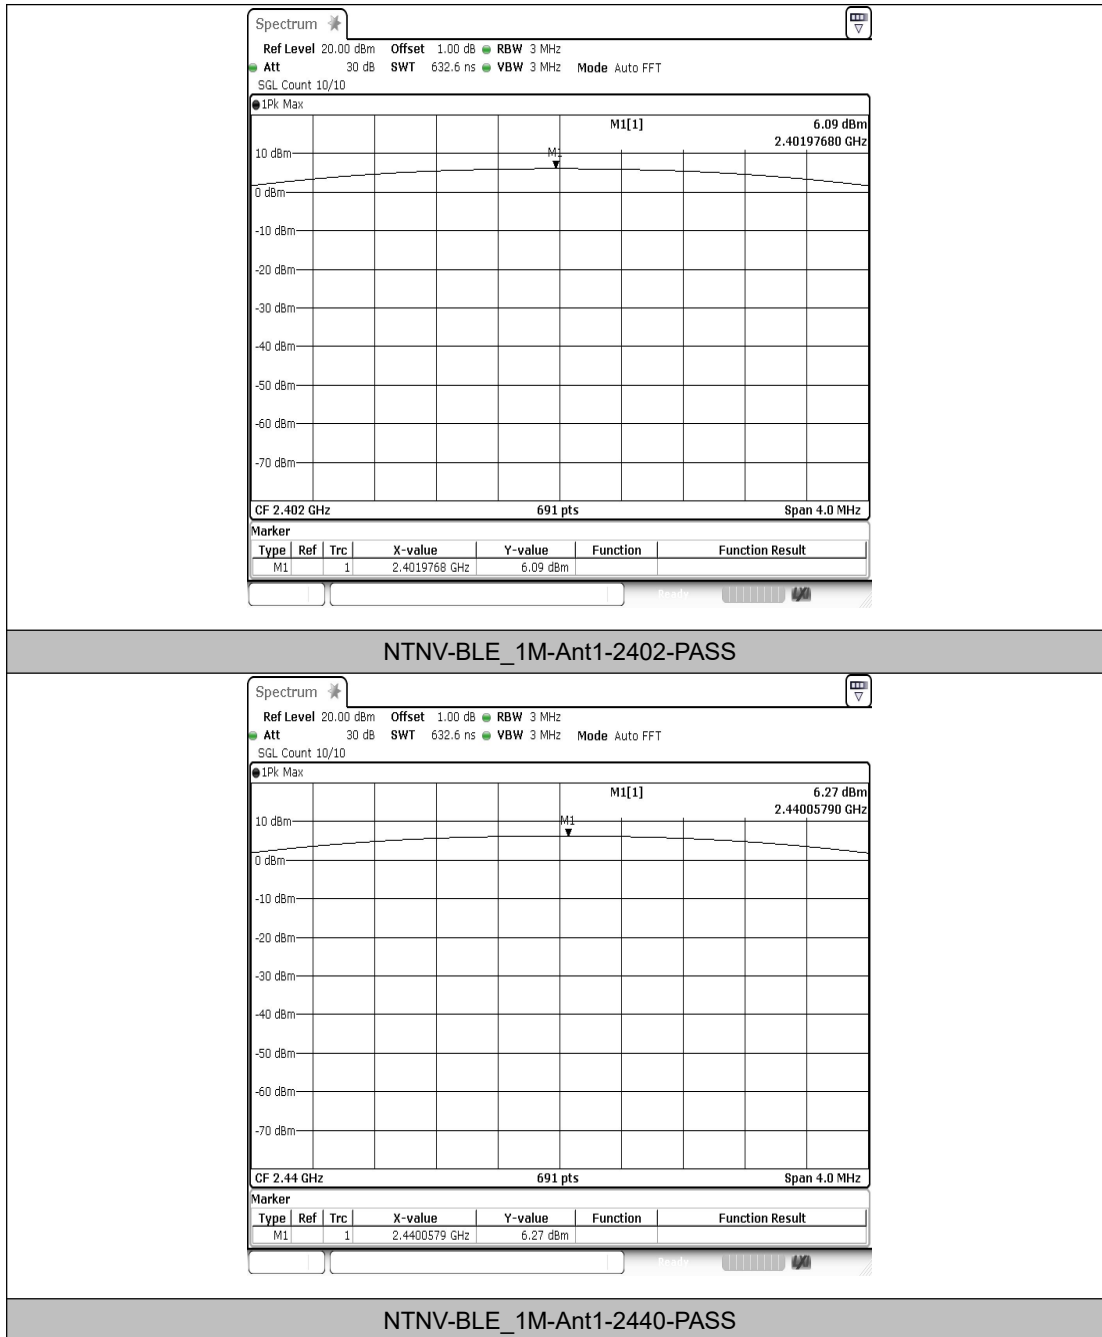


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



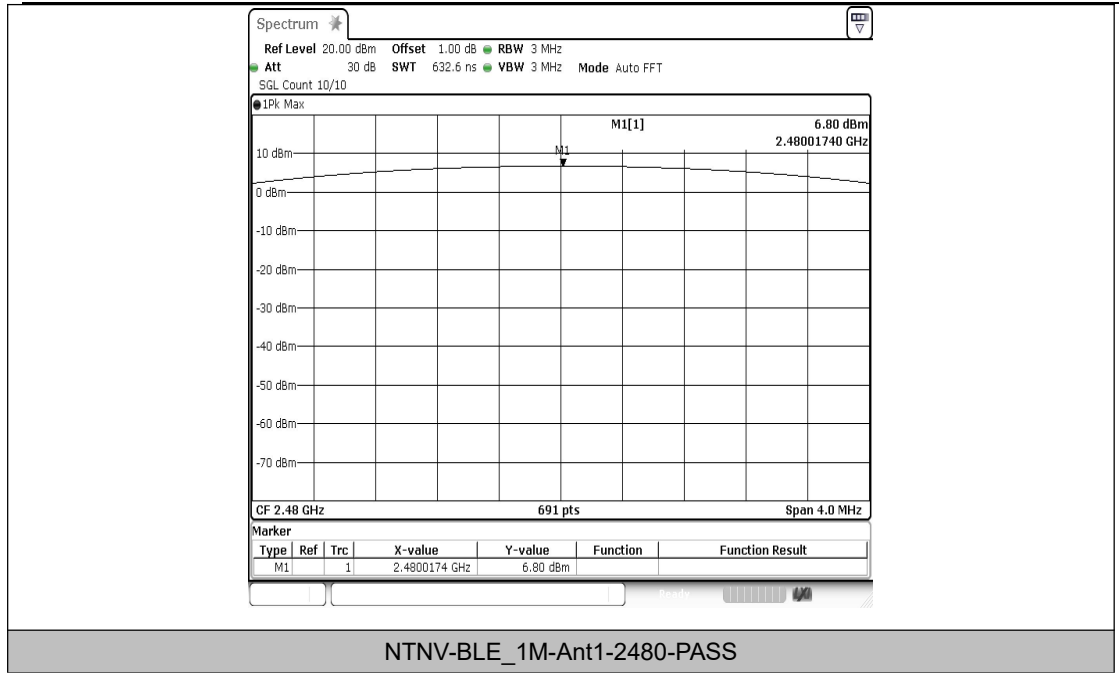

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com




Appendix C: Occupied Bandwidth


Test Result

Test Condition	TestMode	Antenna	Freq.[MHz]	Result[MHz]	Limit [MHz]	Verdict
NTNV	BLE_1M	Ant1	2402	1.275	≤26	PASS
NTNV	BLE_1M	Ant1	2440	1.271	≤26	PASS
NTNV	BLE_1M	Ant1	2480	1.271	≤26	PASS



Test Graphs

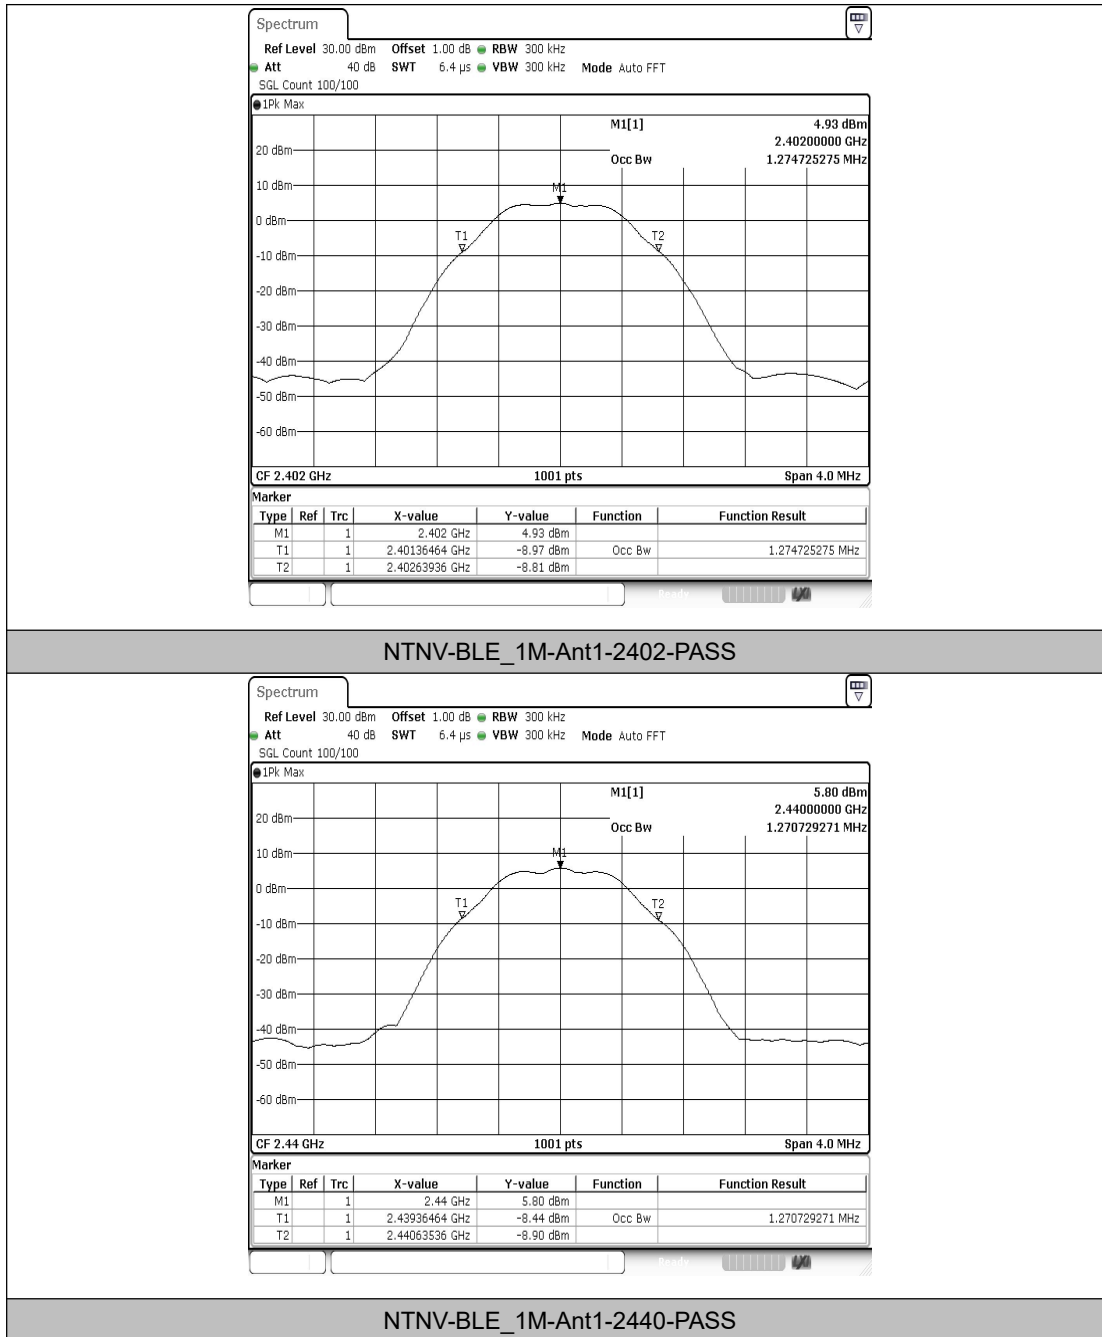

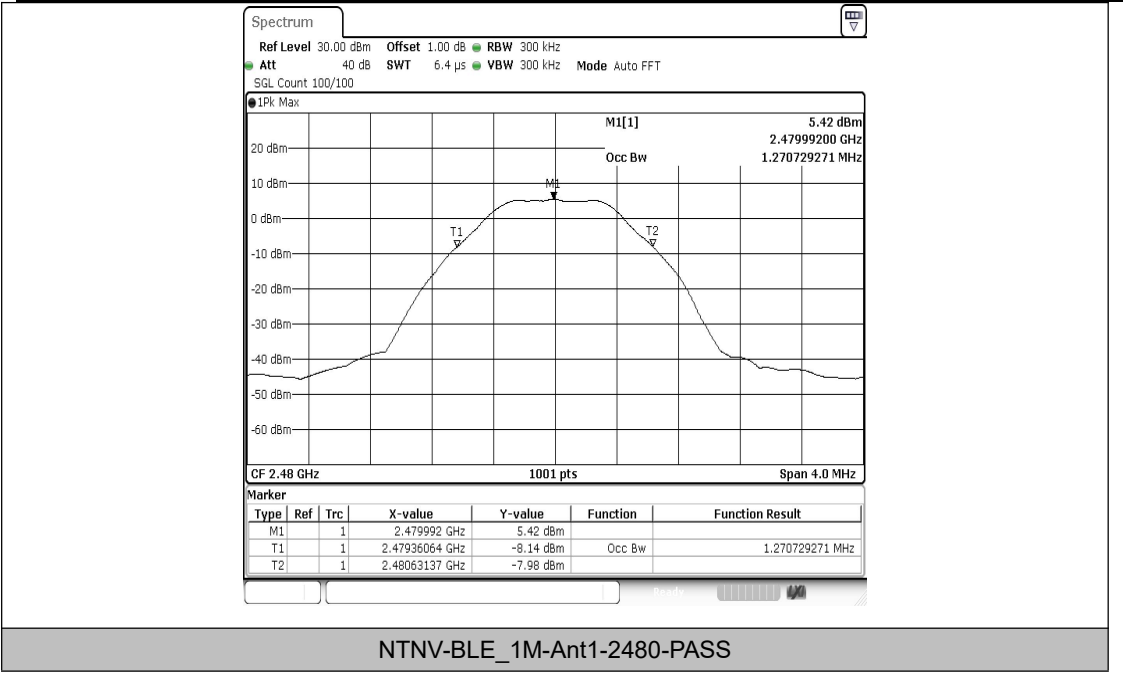

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com




Appendix D: Spurious Emission of TX

Test Result

Test Condition	Test Mode	Antenna	Freq. [MHz]	Freq. Range [MHz]	Freq. [MHz]	Result [dBm/MHz]	Limit [dBm/MHz]	Result [μW/MHz]	Limit [μW/MHz]	Verdict
NTNV	BLE_1M	Ant1	2402	30~1000	936.22	-50.39	≤-26	0.00914	≤2.5	PASS
NTNV	BLE_1M	Ant1	2402	1000~2387	2013.20	-48.50	≤-26	0.01413	≤2.5	PASS
NTNV	BLE_1M	Ant1	2402	2387~2400	2399.99	-29.30	≤-16	1.17490	≤25	PASS
NTNV	BLE_1M	Ant1	2402	2483.5~2496.5	2494.76	-38.19	≤-16	0.15171	≤25	PASS
NTNV	BLE_1M	Ant1	2402	2496.5~13000	6897.99	-44.41	≤-26	0.03622	≤2.5	PASS
NTNV	BLE_1M	Ant1	2440	30~1000	839.22	-49.99	≤-26	0.01002	≤2.5	PASS
NTNV	BLE_1M	Ant1	2440	1000~2387	2380.07	-47.60	≤-26	0.01738	≤2.5	PASS
NTNV	BLE_1M	Ant1	2440	2387~2400	2399.61	-38.19	≤-16	0.15171	≤25	PASS
NTNV	BLE_1M	Ant1	2440	2483.5~2496.5	2493.98	-38.05	≤-16	0.15668	≤25	PASS
NTNV	BLE_1M	Ant1	2440	2496.5~13000	6976.24	-44.10	≤-26	0.03890	≤2.5	PASS
NTNV	BLE_1M	Ant1	2480	30~1000	783.93	-50.15	≤-26	0.00966	≤2.5	PASS
NTNV	BLE_1M	Ant1	2480	1000~2387	2348.16	-48.58	≤-26	0.01387	≤2.5	PASS
NTNV	BLE_1M	Ant1	2480	2387~2400	2399.90	-38.46	≤-16	0.14256	≤25	PASS
NTNV	BLE_1M	Ant1	2480	2483.5~2496.5	2483.53	-35.33	≤-16	0.29309	≤25	PASS
NTNV	BLE_1M	Ant1	2480	2496.5~13000	6987.80	-44.29	≤-26	0.03724	≤2.5	PASS



Test Graphs

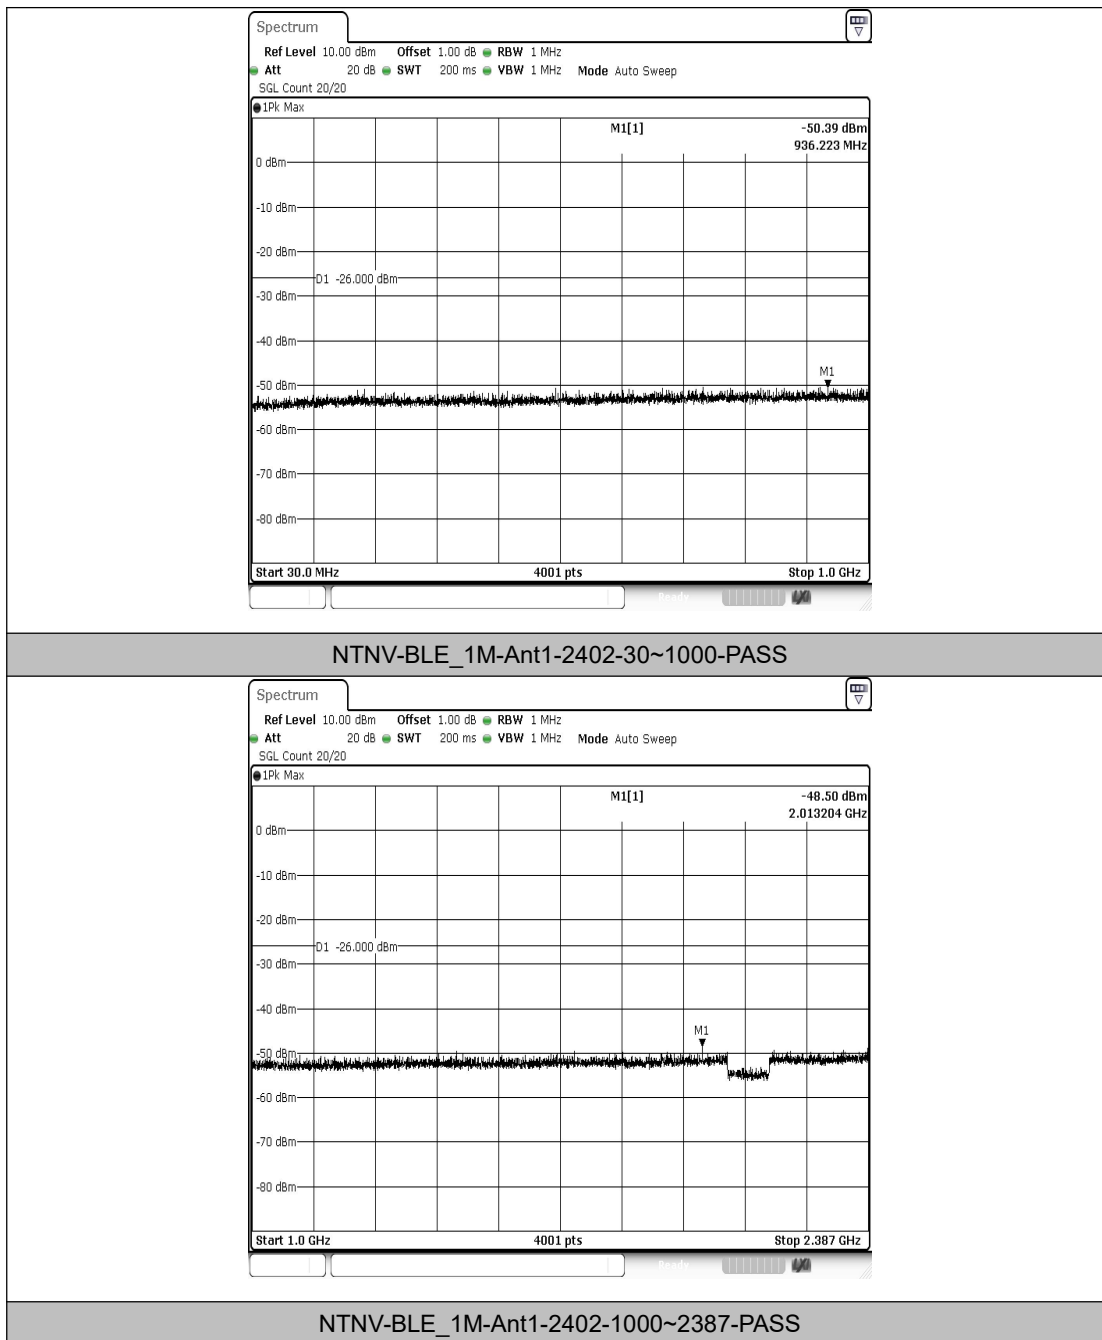


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



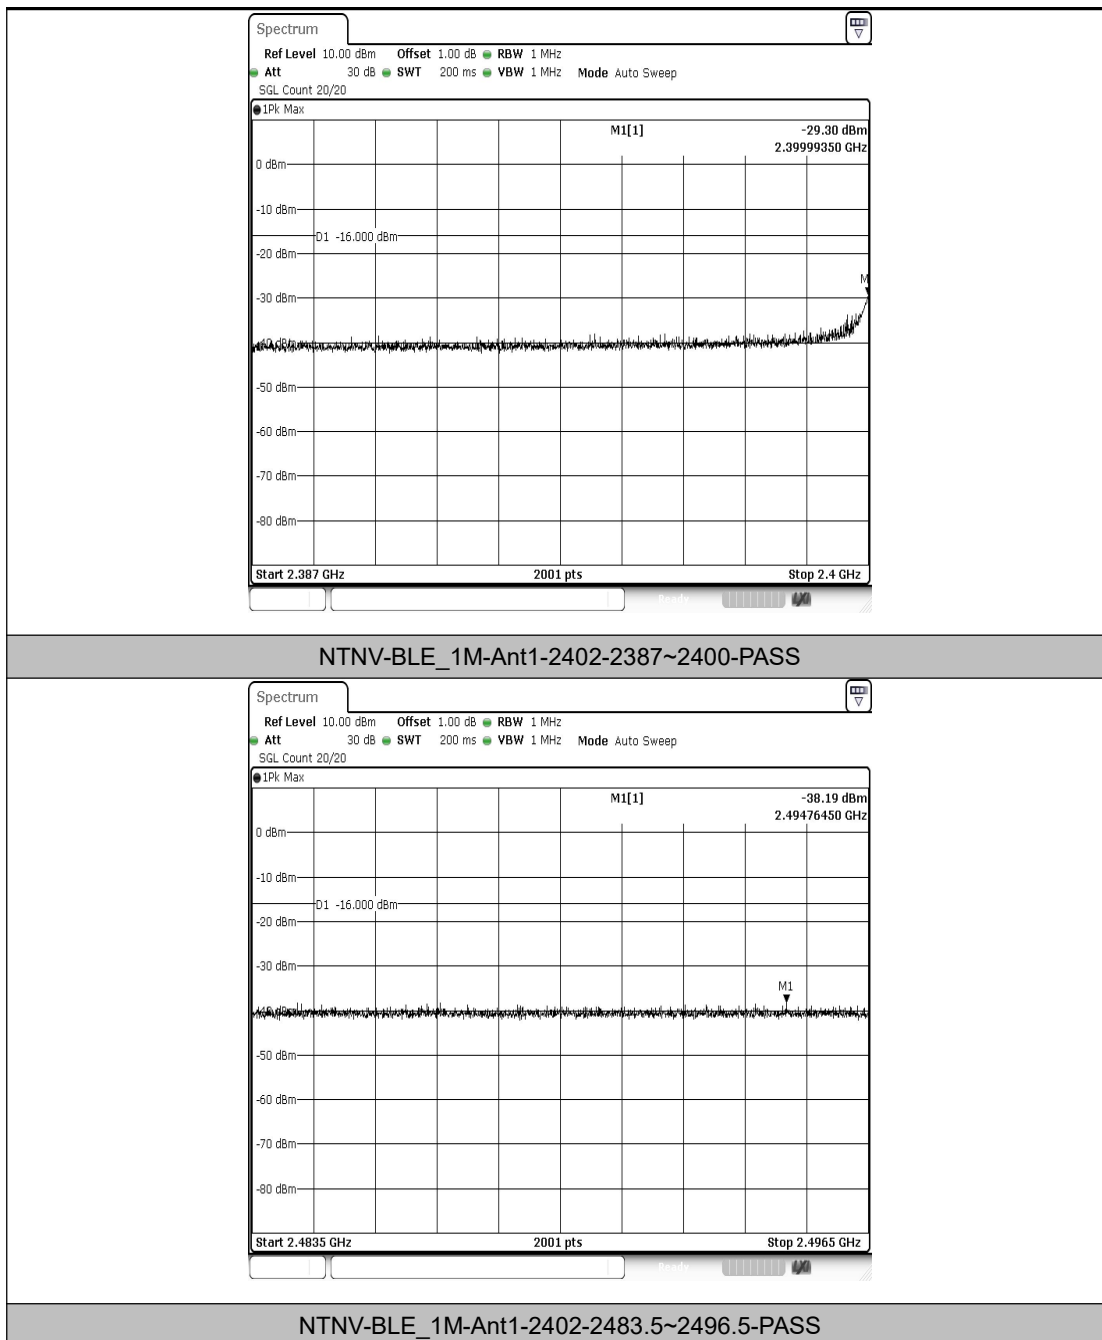


Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



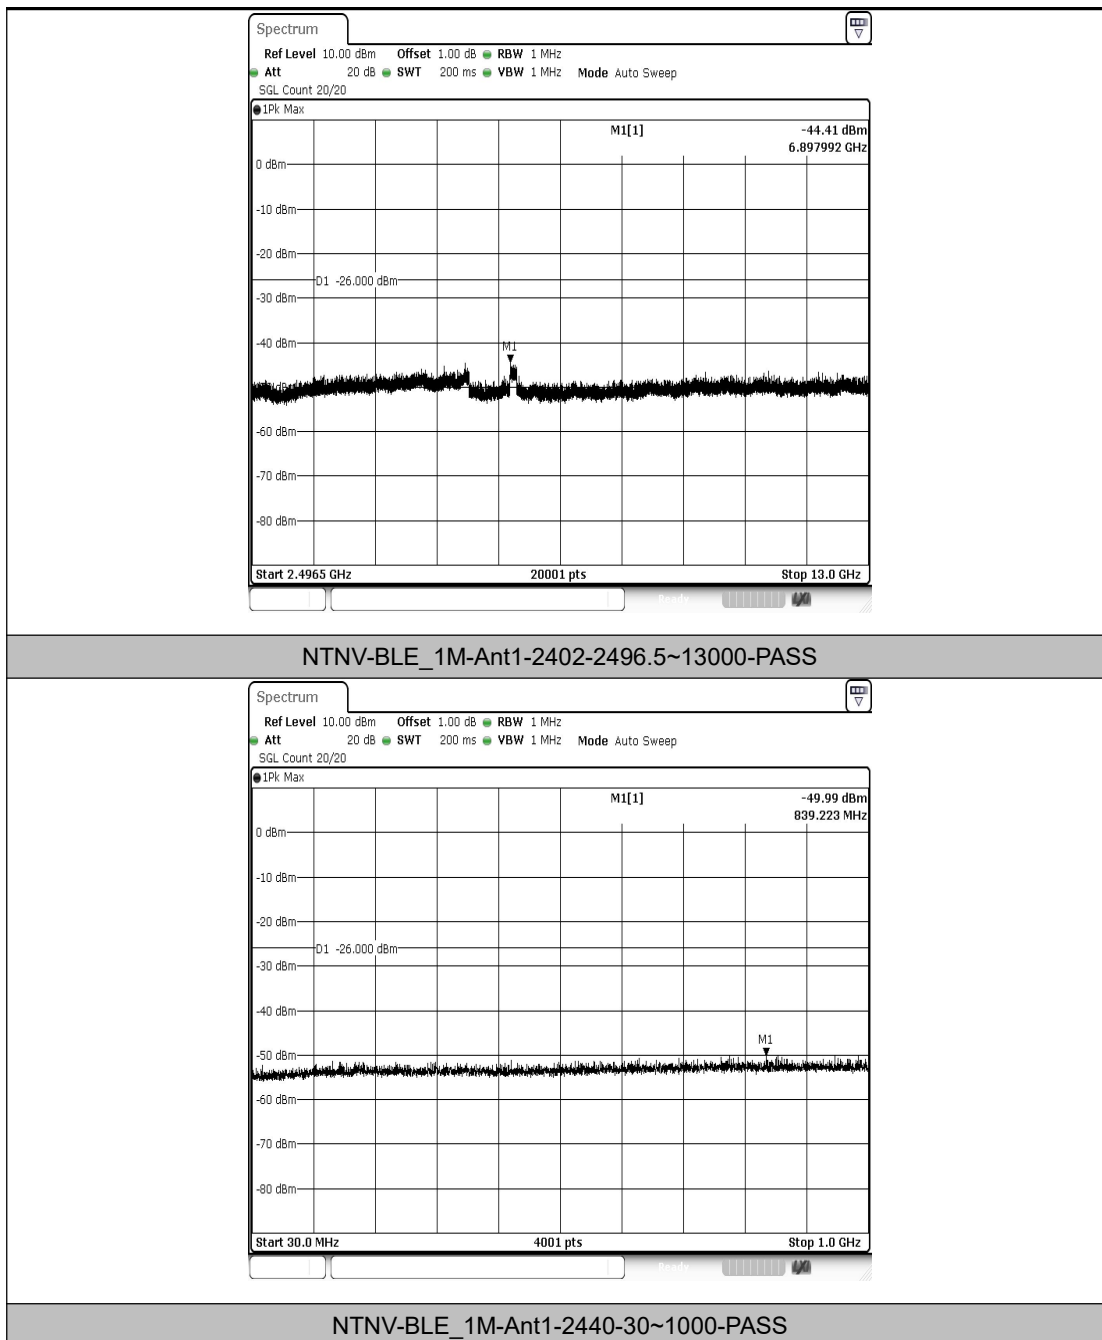

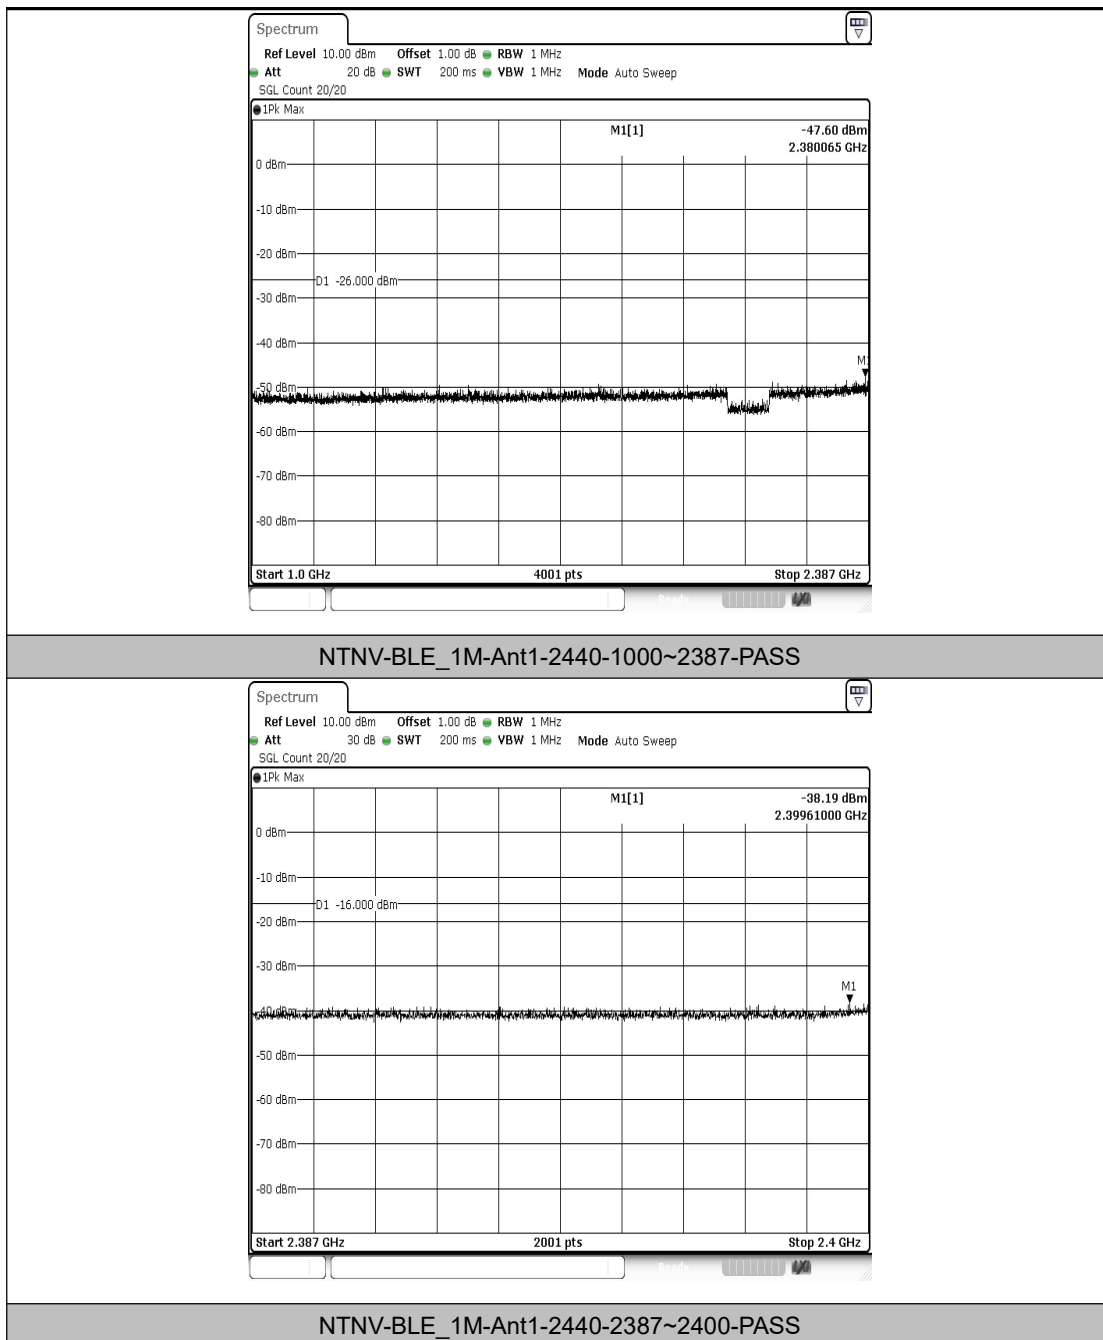


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com



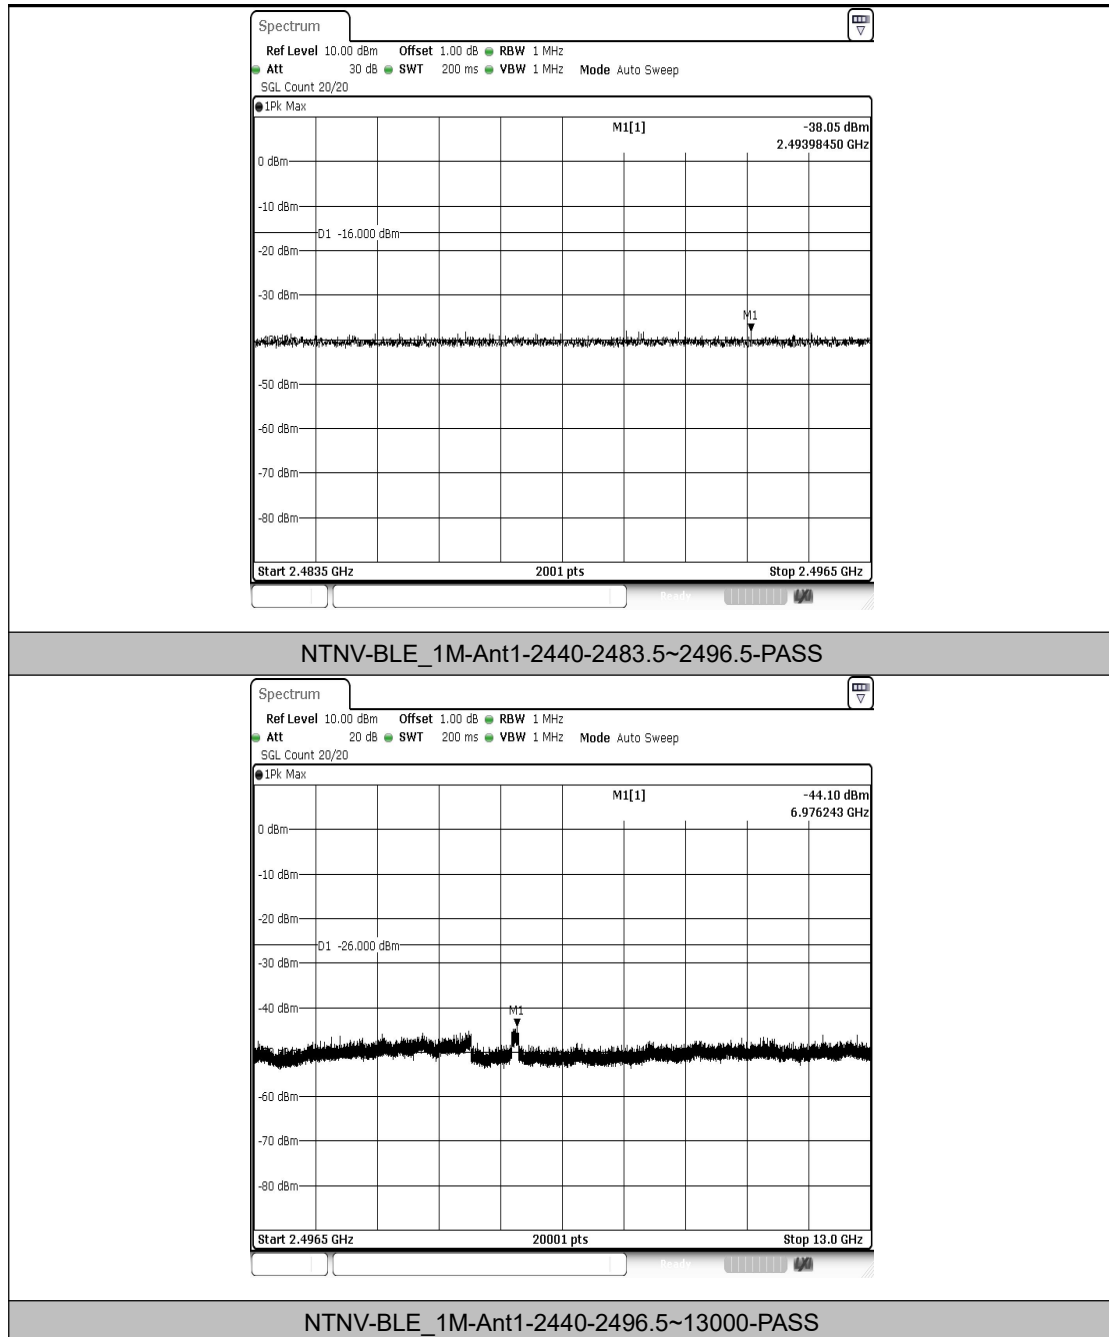


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



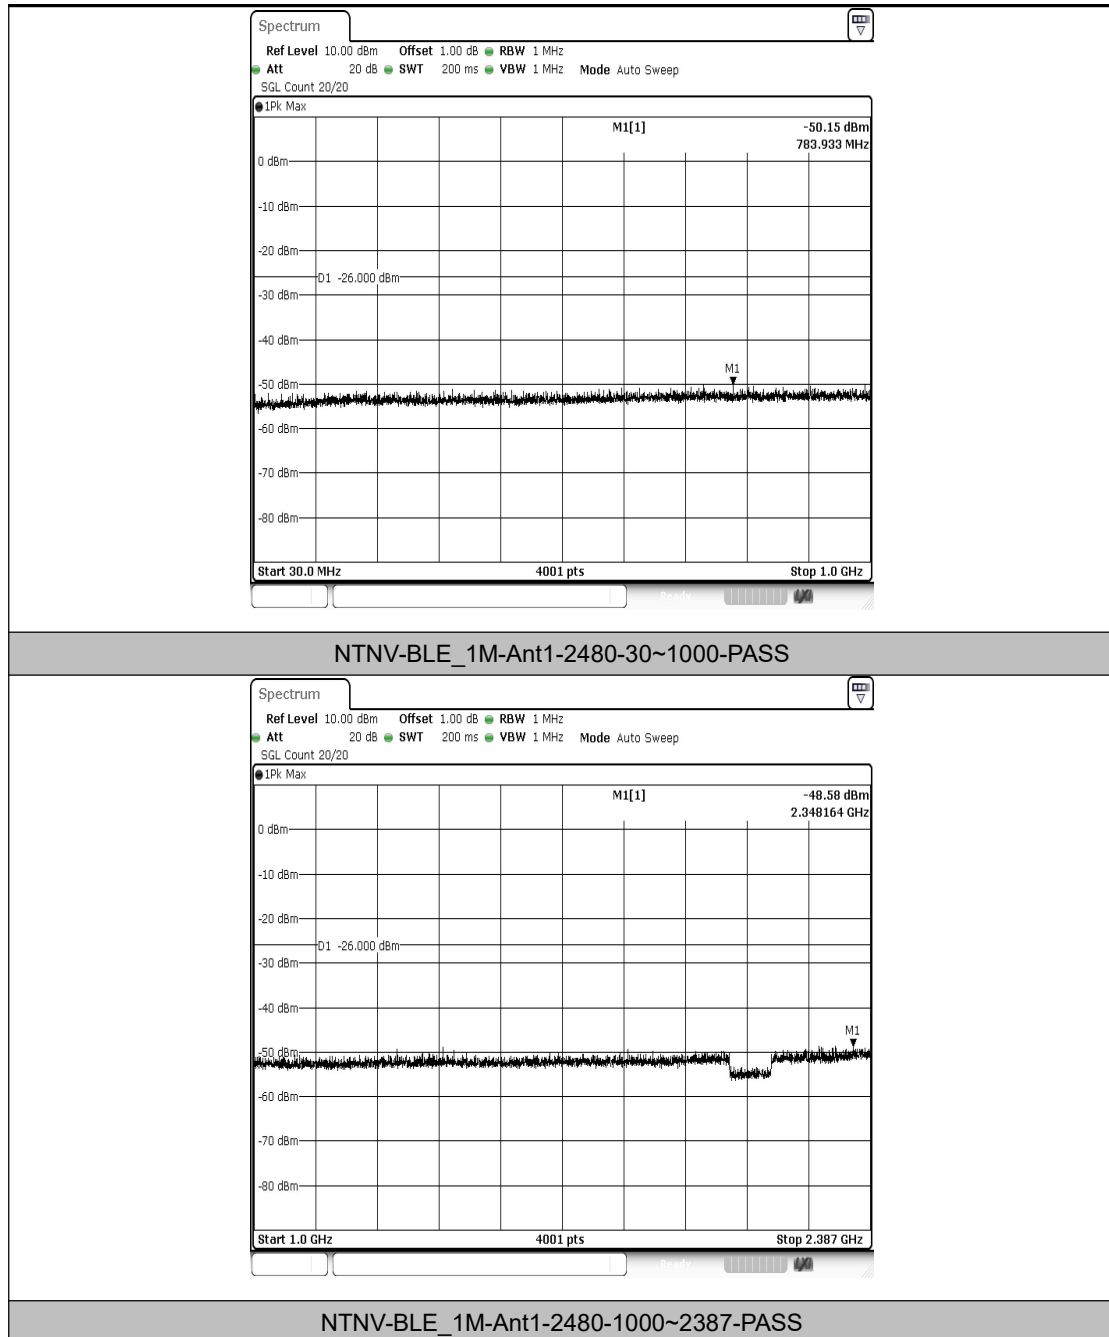


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com



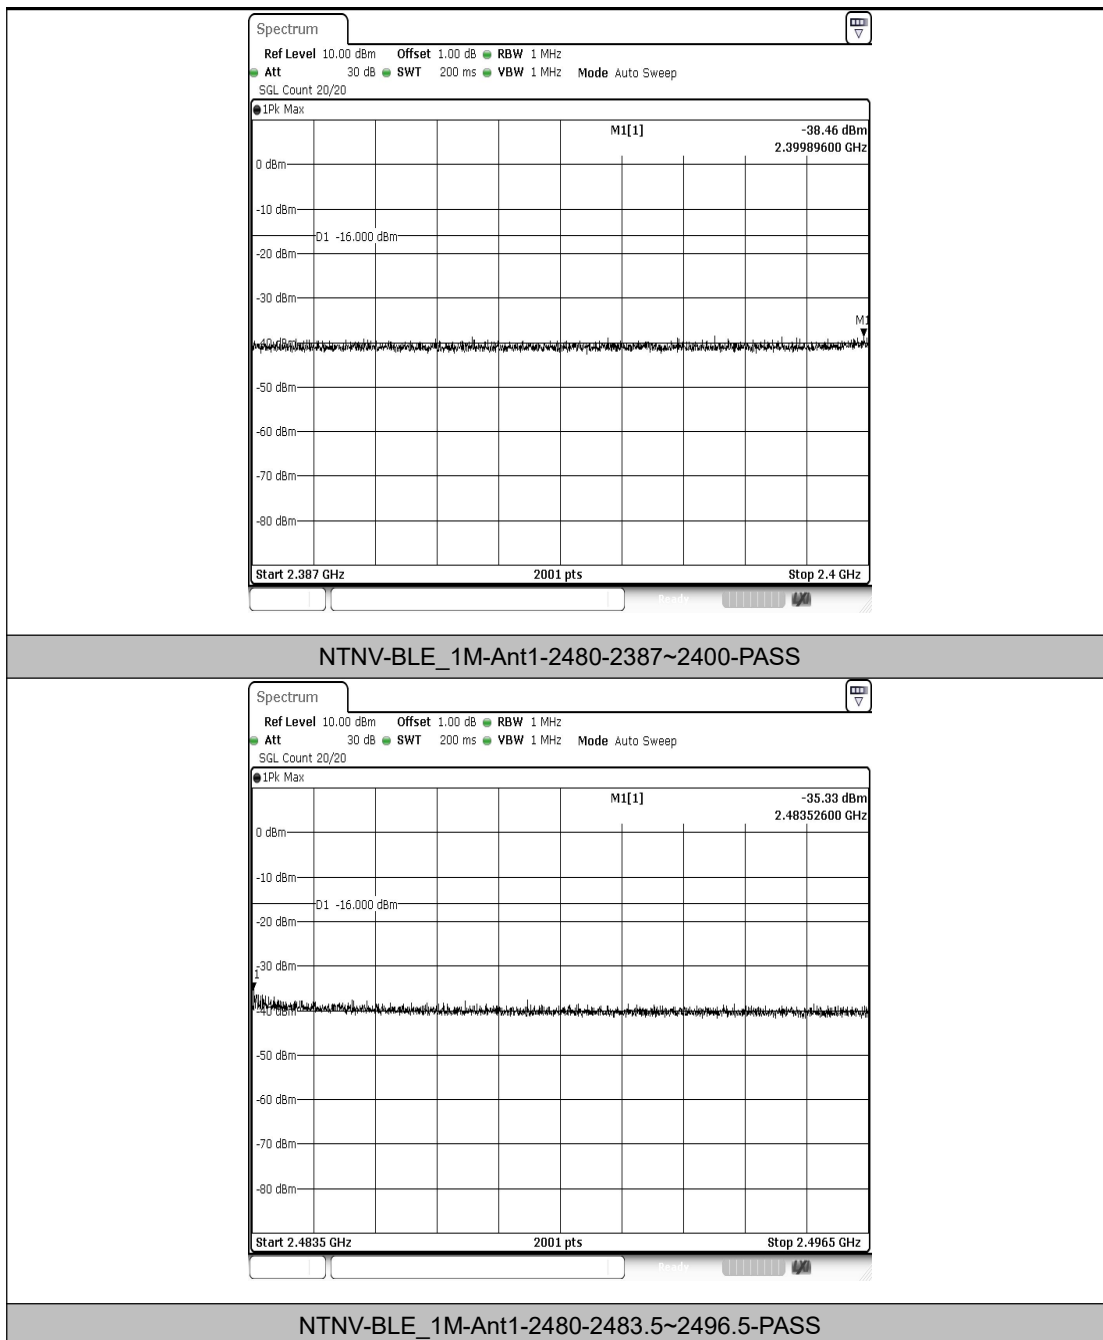


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



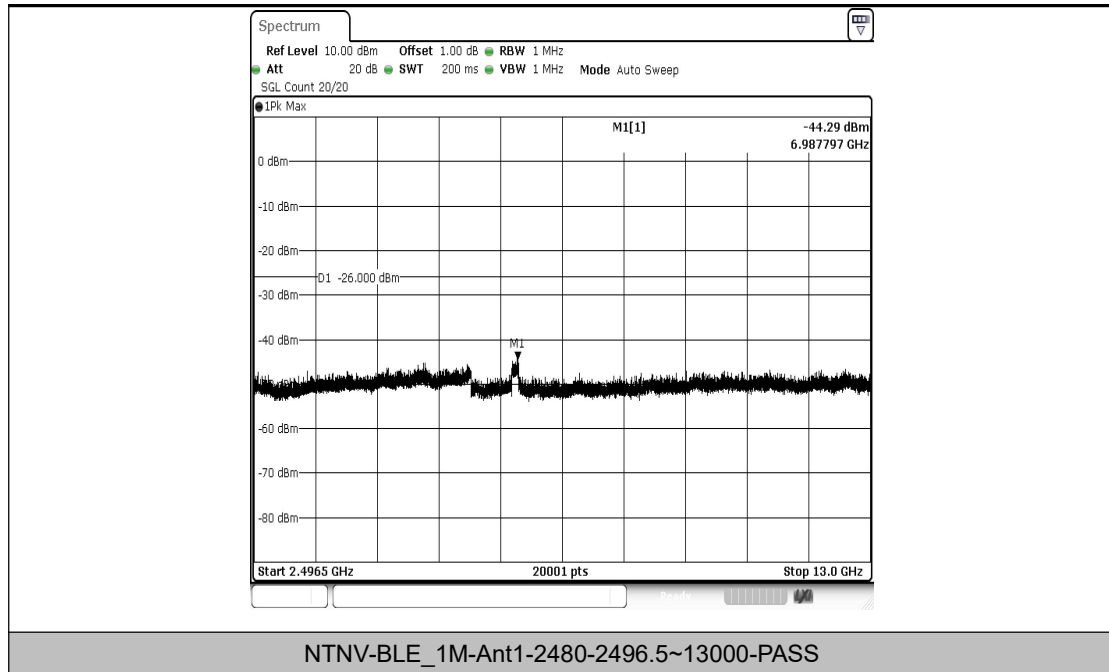

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com





Appendix E: Spurious Emission of RX


Test Result


Test Condition	Test Mode	Antenna	Freq. [MHz]	Freq.Range [MHz]	Freq. [MHz]	Result [dBm/MHz]	Limit [dBm]	Result [nW]	Limit [nW]	Verdict
NTNV	BLE_1M	Ant1	2402	30~1000	440.35	-82.04	≤-54	0.00625	≤4	PASS
NTNV	BLE_1M	Ant1	2402	1000~12500	6897.19	-66.04	≤-47	0.24889	≤20	PASS
NTNV	BLE_1M	Ant1	2440	30~1000	819.91	-82.19	≤-54	0.00604	≤4	PASS
NTNV	BLE_1M	Ant1	2440	1000~12500	6950.09	-65.62	≤-47	0.27416	≤20	PASS
NTNV	BLE_1M	Ant1	2480	30~1000	919.29	-81.44	≤-54	0.00718	≤4	PASS
NTNV	BLE_1M	Ant1	2480	1000~12500	6902.37	-65.34	≤-47	0.29242	≤20	PASS

Test Graphs

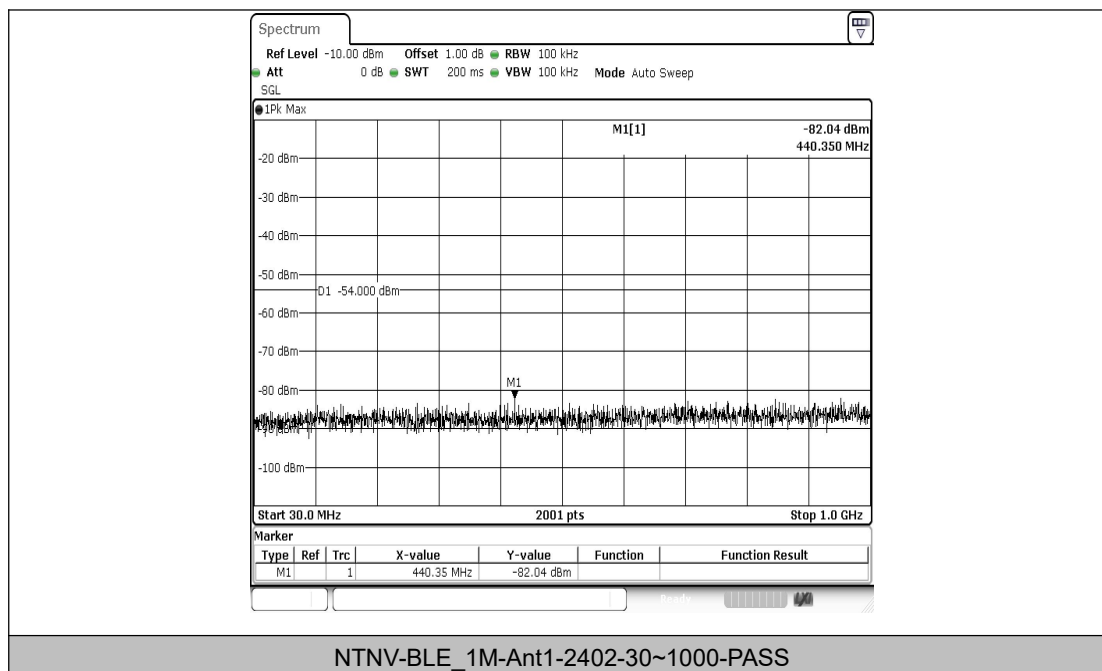

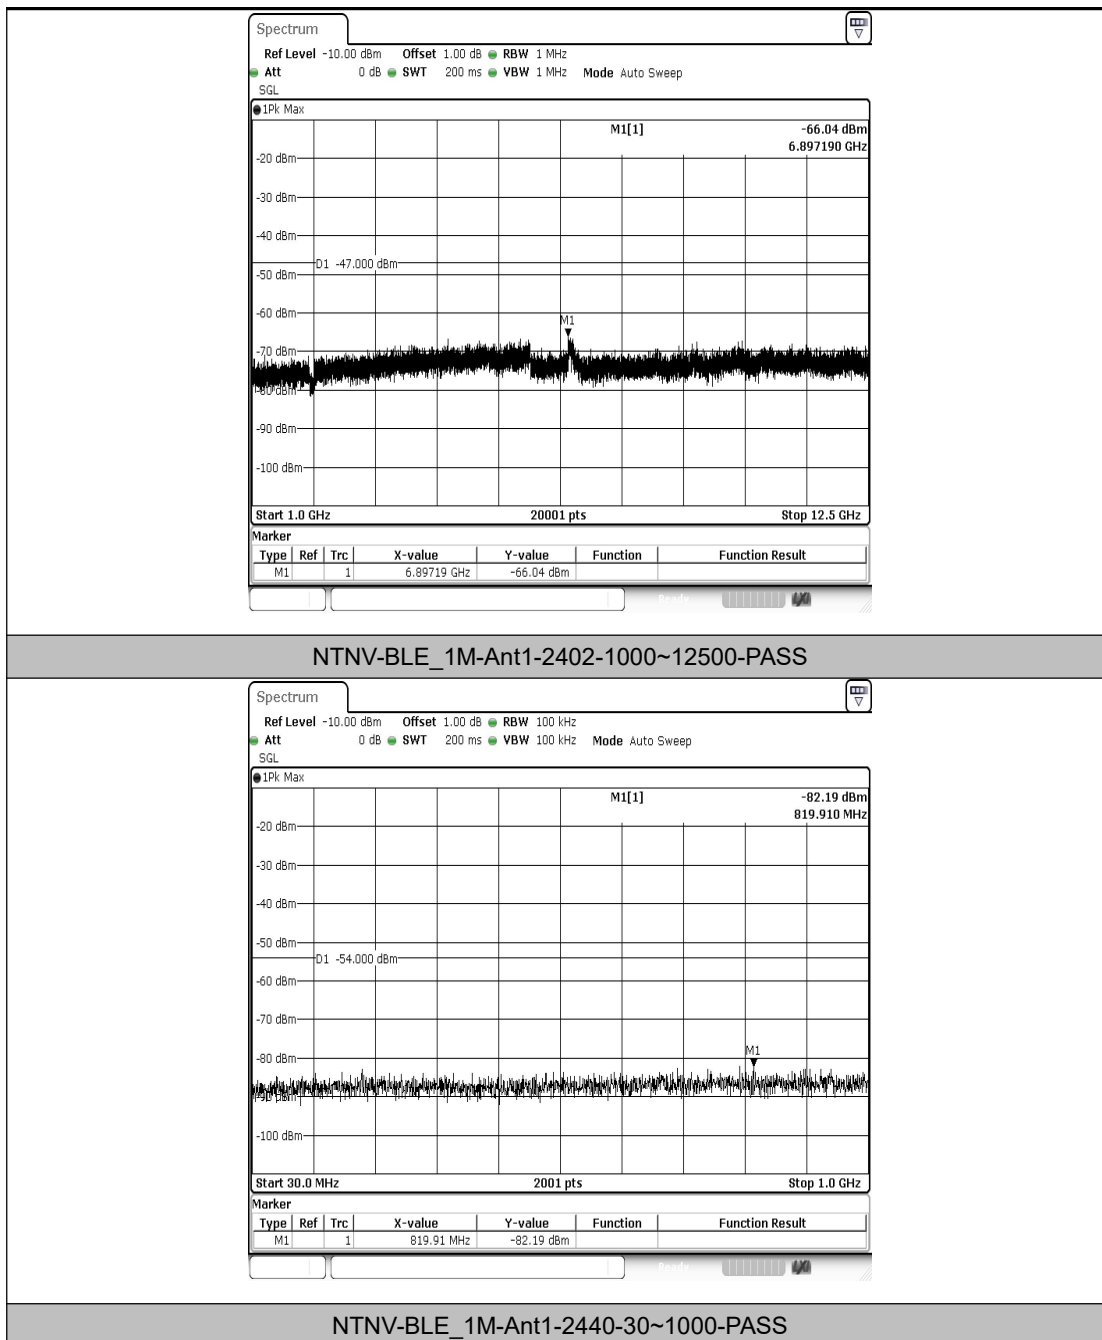

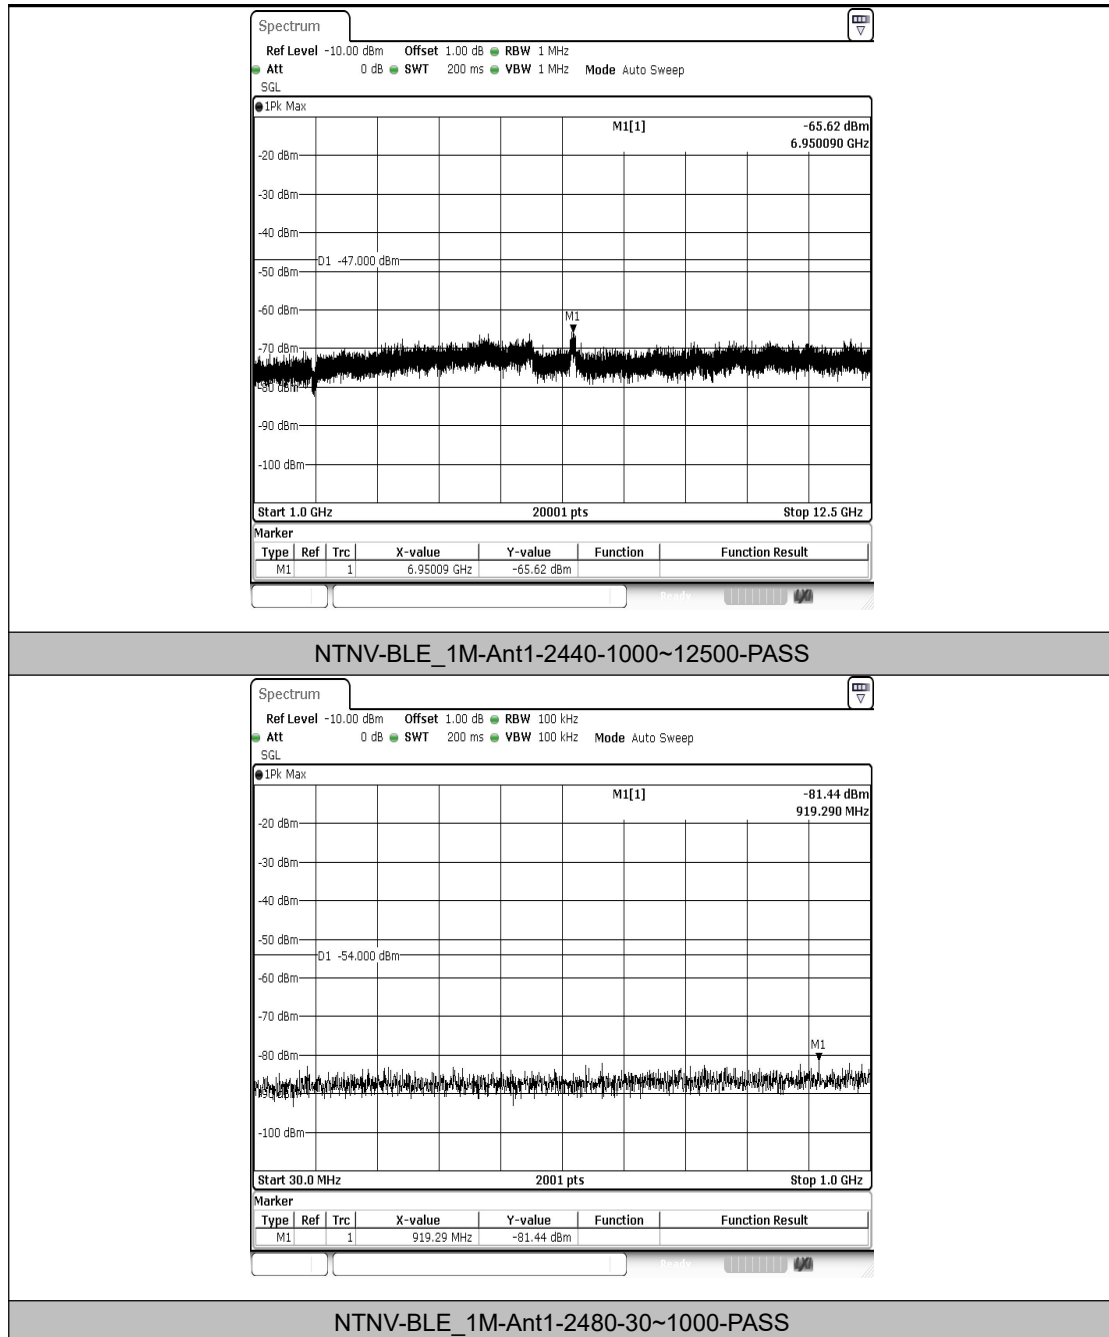

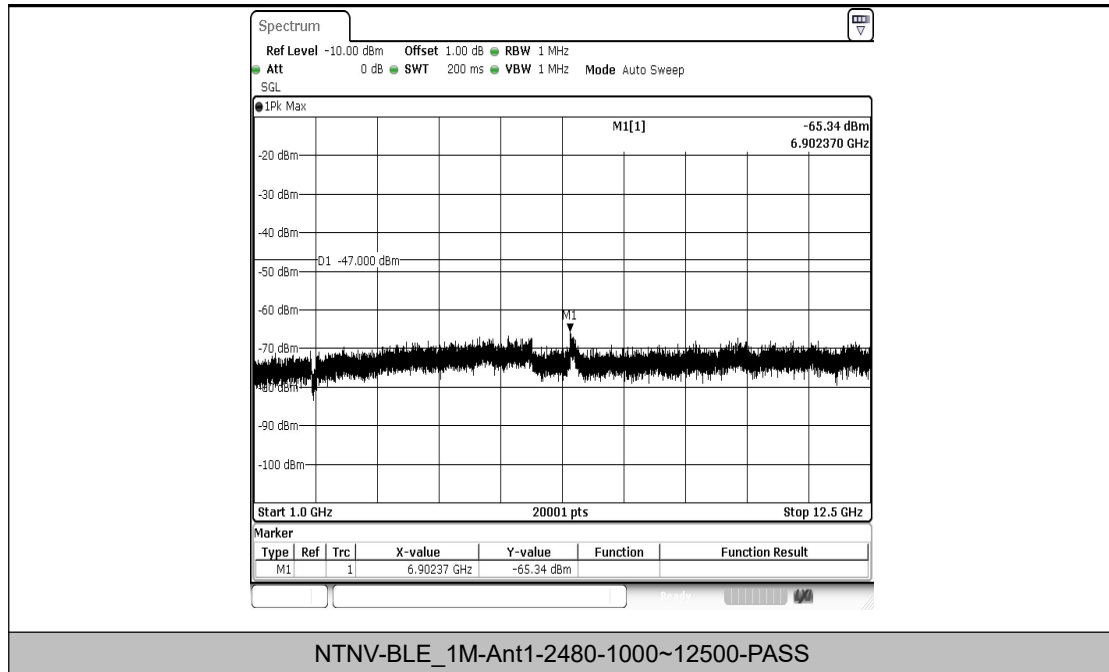

---END---

