






NTHV_DH5_Ant1_2480_2387~2400

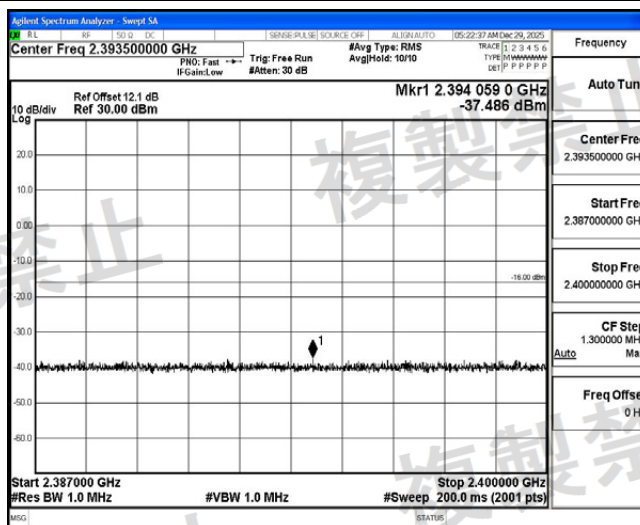

NTHV_DH5_Ant1_2480_2483.5~2496.5

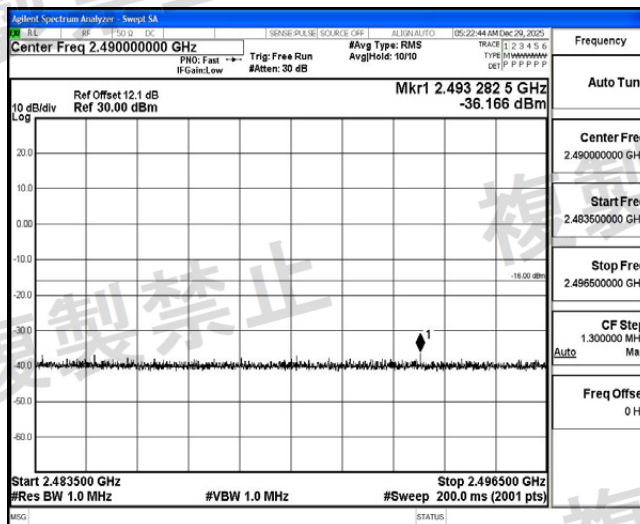


NTHV_DH5_Ant1_2480_2496.5~13000

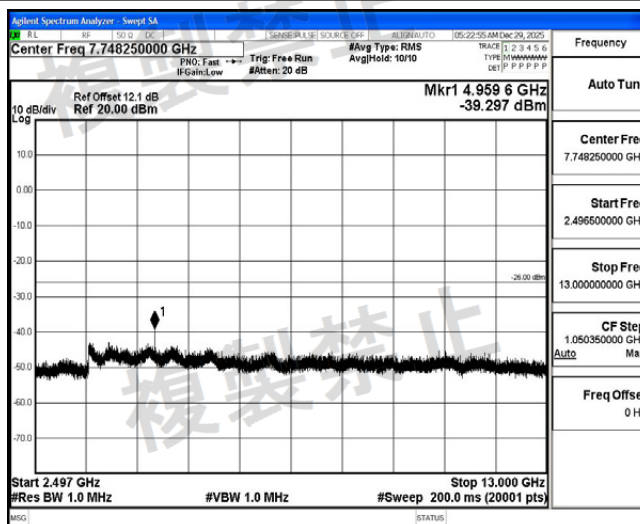





NTHV_2DH5_Ant1_2402_30~1000

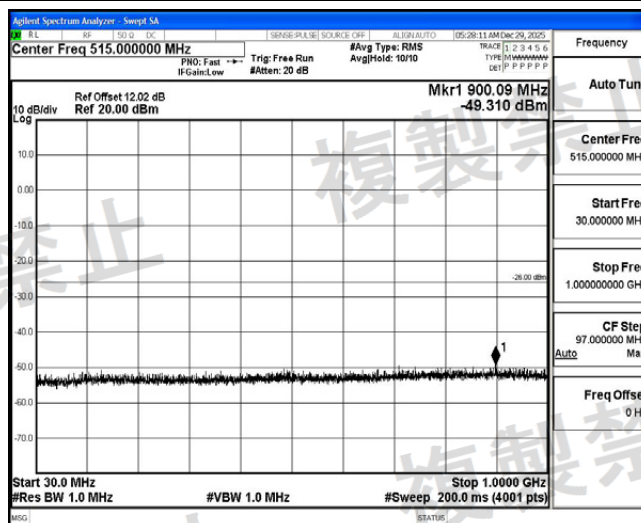

NTHV_2DH5_Ant1_2402_1000~2387

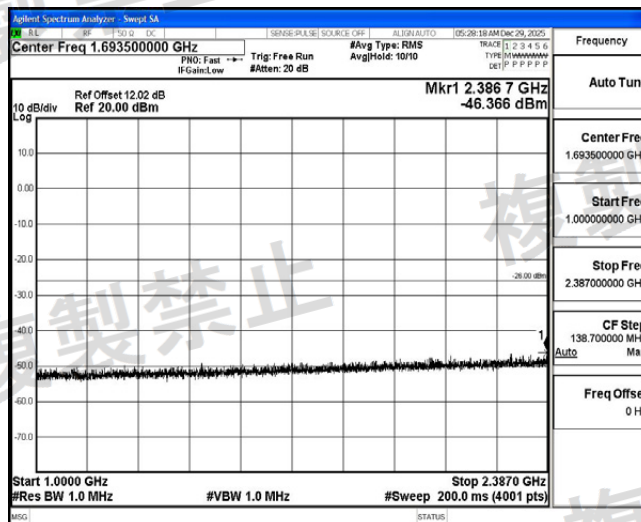


NTHV_2DH5_Ant1_2402_2387~2400

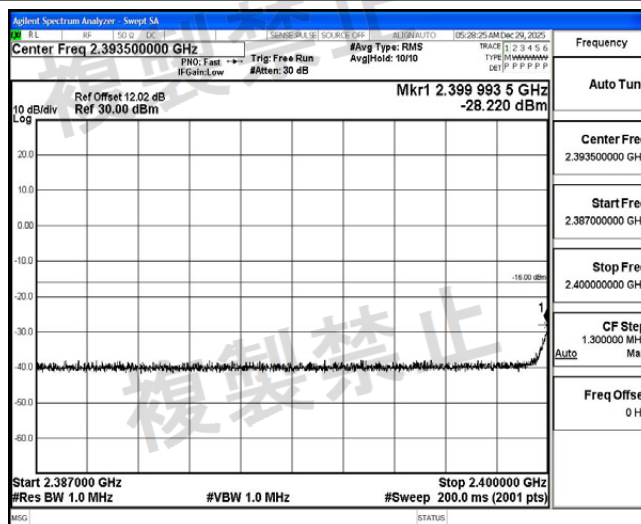





NTHV_2DH5_Ant1_2402_2483.5~2496.5

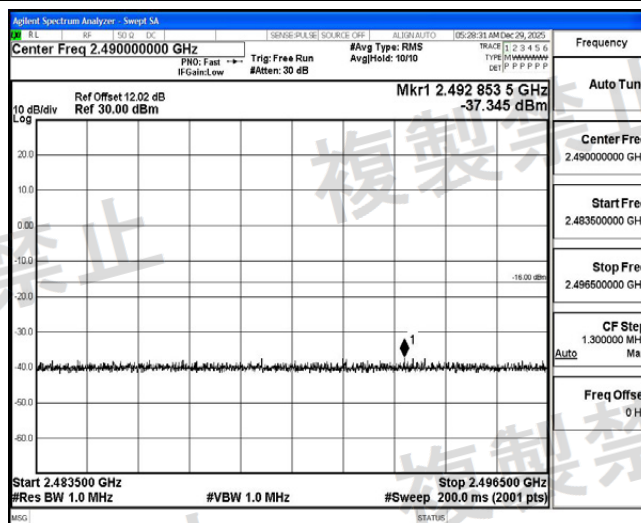

NTHV_2DH5_Ant1_2402_2496.5~13000

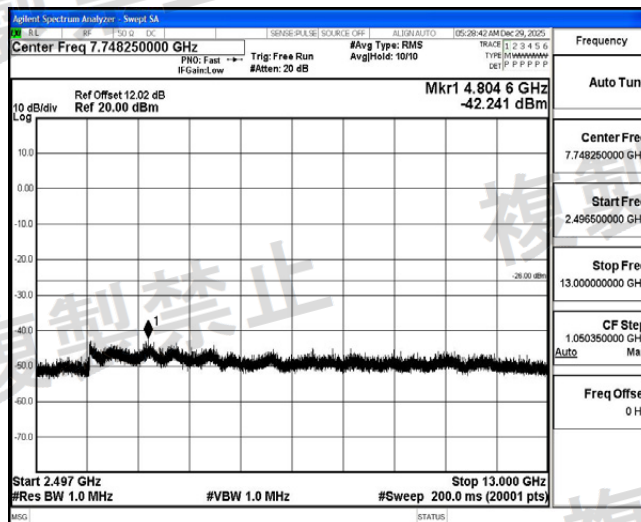


NTHV_2DH5_Ant1_2441_30~1000

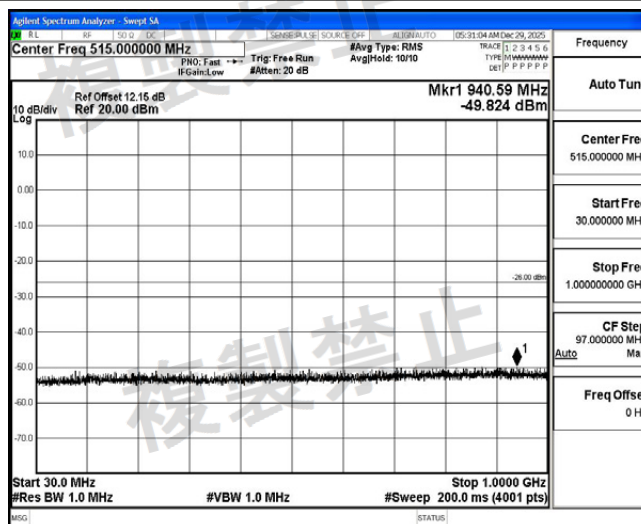





NTHV_2DH5_Ant1_2441_1000~2387

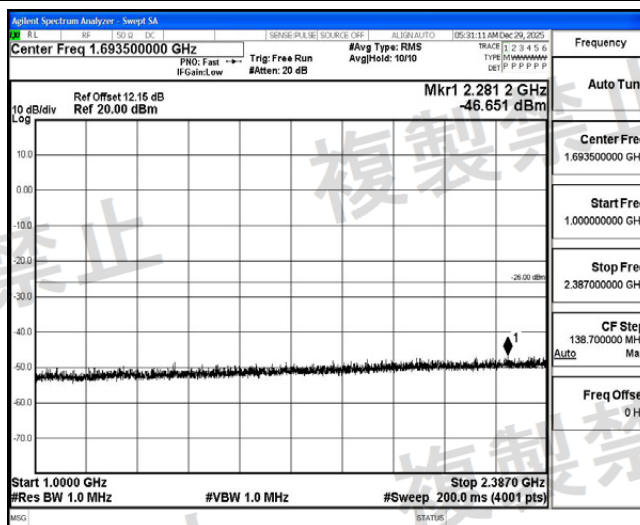

NTHV_2DH5_Ant1_2441_2387~2400

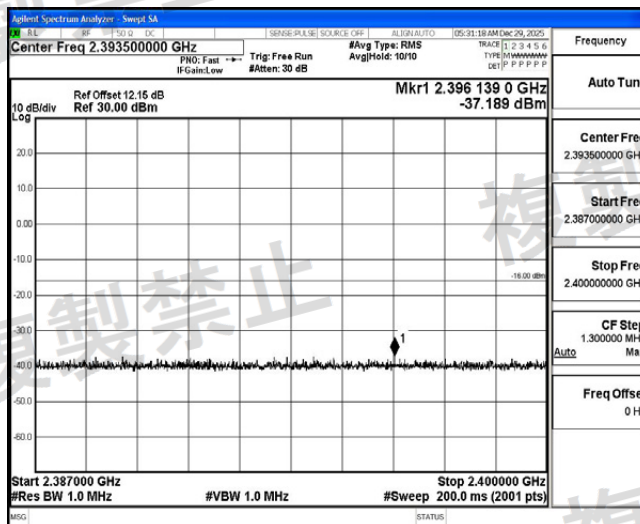


NTHV_2DH5_Ant1_2441_2483.5~2496.5

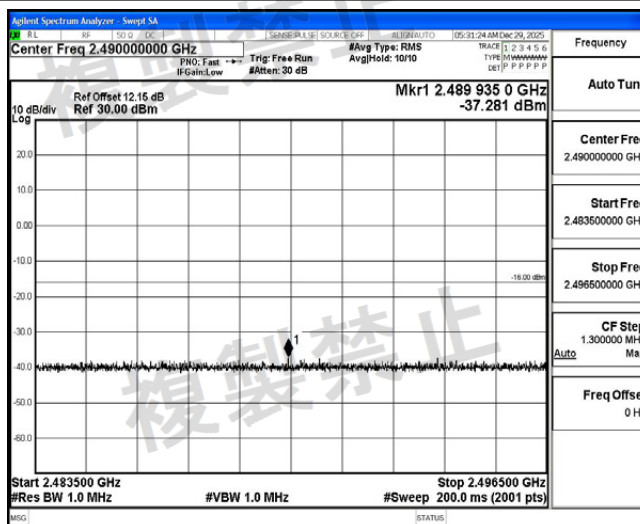





NTHV_2DH5_Ant1_2441_2496.5~13000

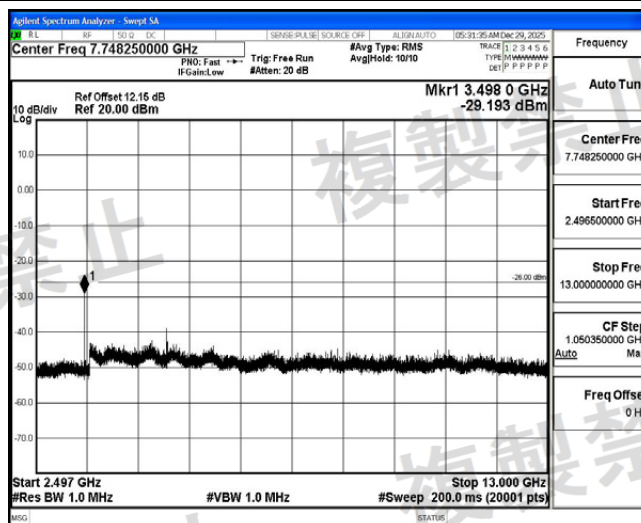

NTHV_2DH5_Ant1_2480_30~1000

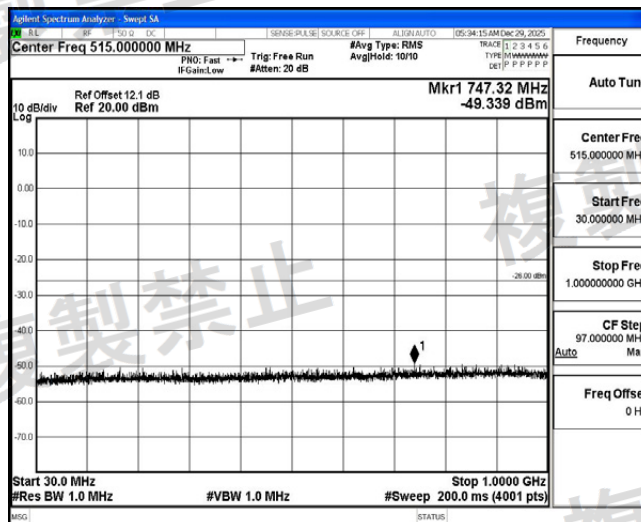


NTHV_2DH5_Ant1_2480_1000~2387

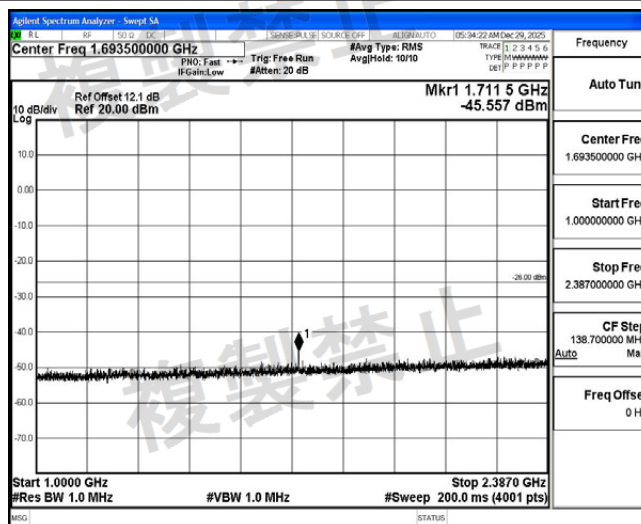





NTHV_2DH5_Ant1_2480_2387~2400

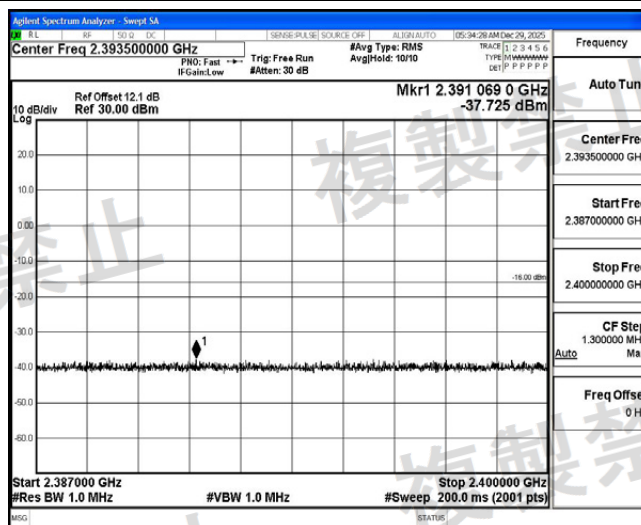

NTHV_2DH5_Ant1_2480_2483.5~2496.5

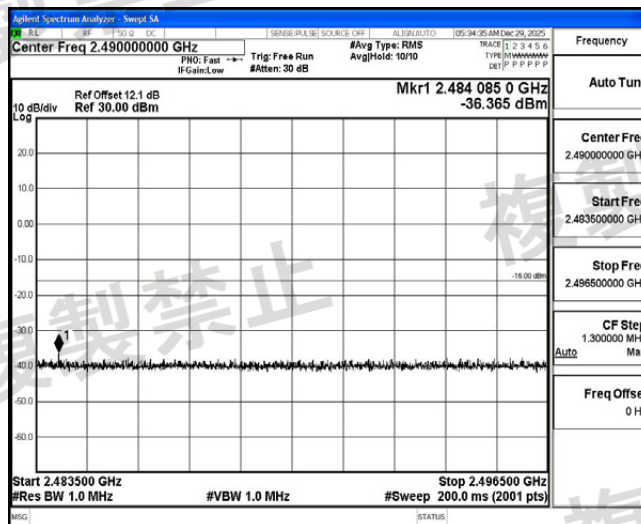


NTHV_2DH5_Ant1_2480_2496.5~13000

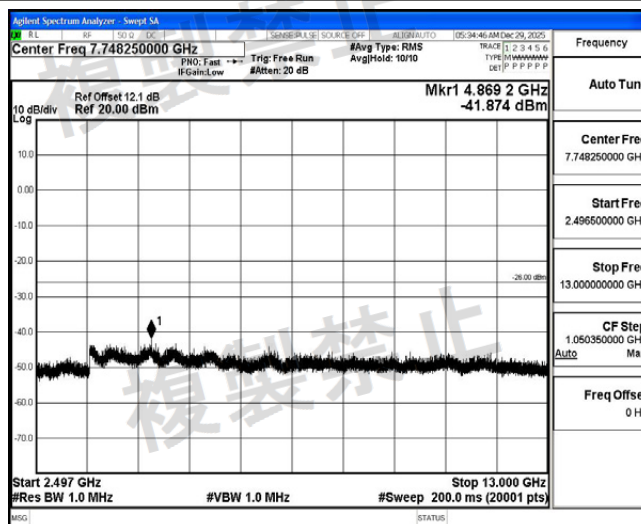





NTHV_3DH5_Ant1_2402_30~1000

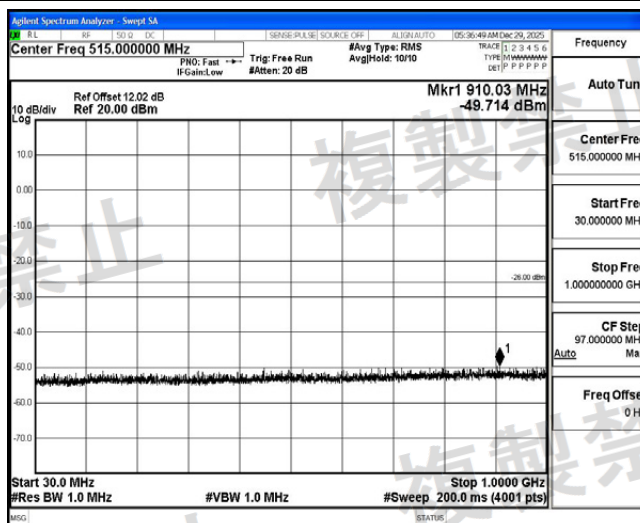

NTHV_3DH5_Ant1_2402_1000~2387

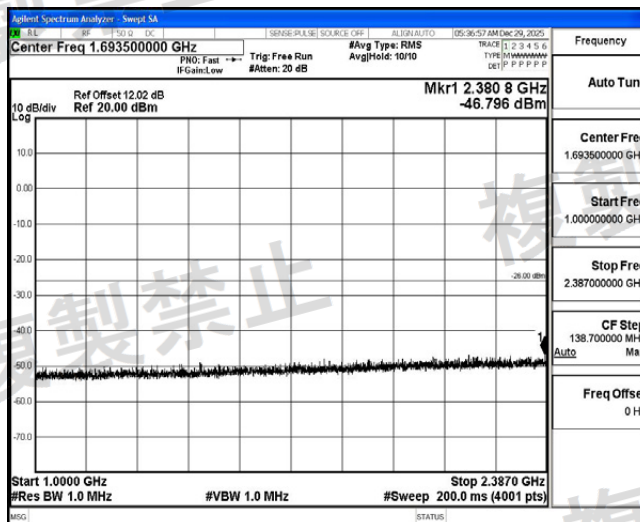


NTHV_3DH5_Ant1_2402_2387~2400

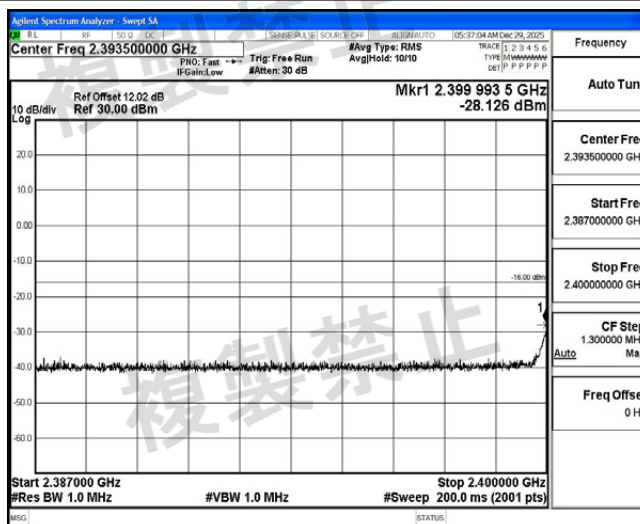





NTHV_3DH5_Ant1_2402_2483.5~2496.5

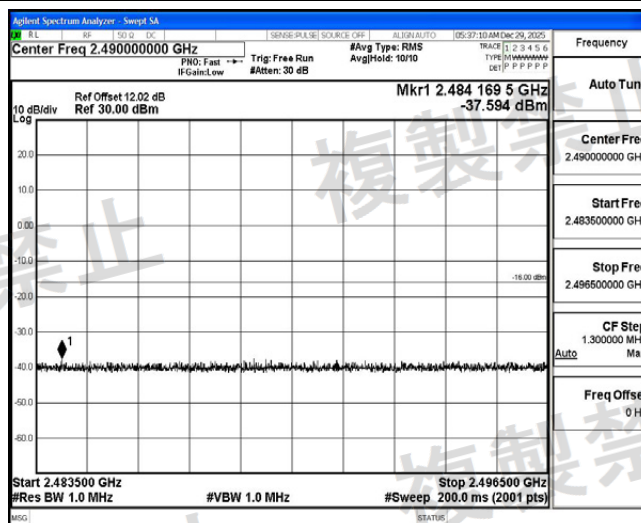

NTHV_3DH5_Ant1_2402_2496.5~13000

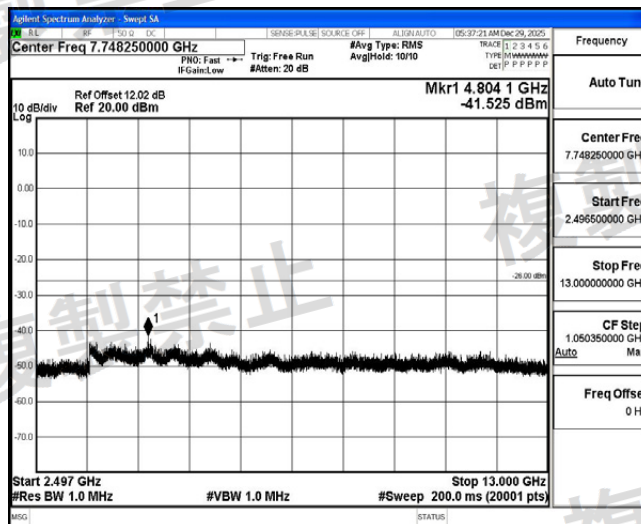


NTHV_3DH5_Ant1_2441_30~1000

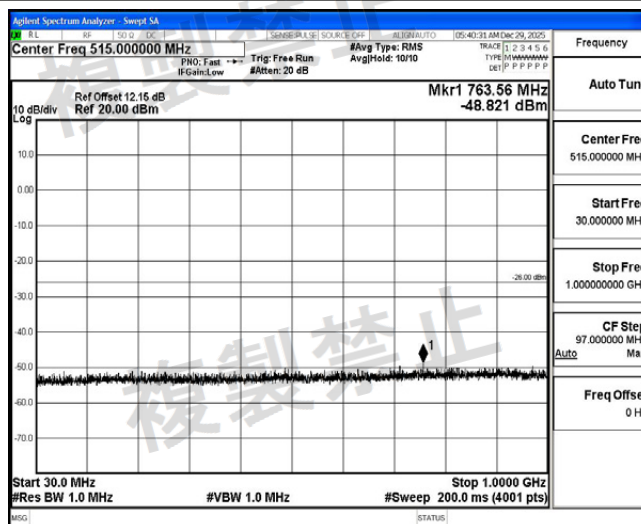





NTHV_3DH5_Ant1_2441_1000~2387

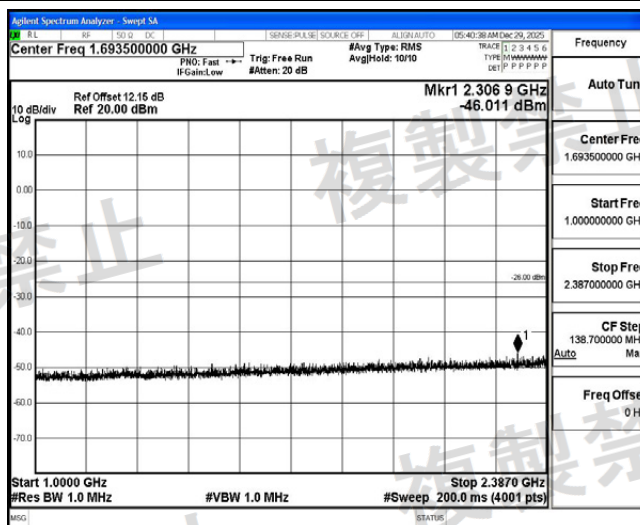

NTHV_3DH5_Ant1_2441_2387~2400

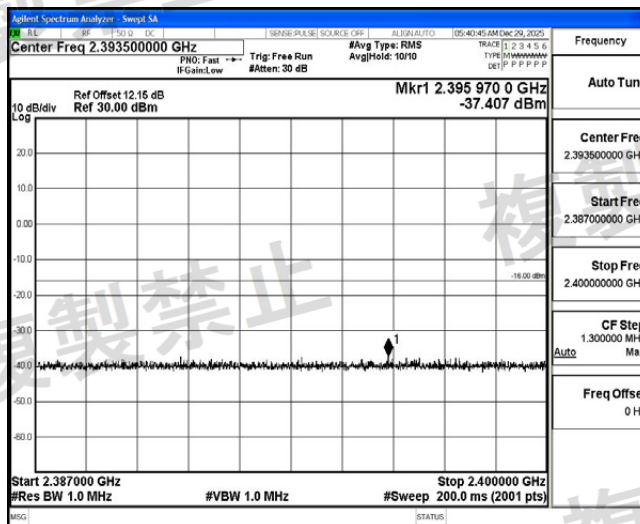


NTHV_3DH5_Ant1_2441_2483.5~2496.5

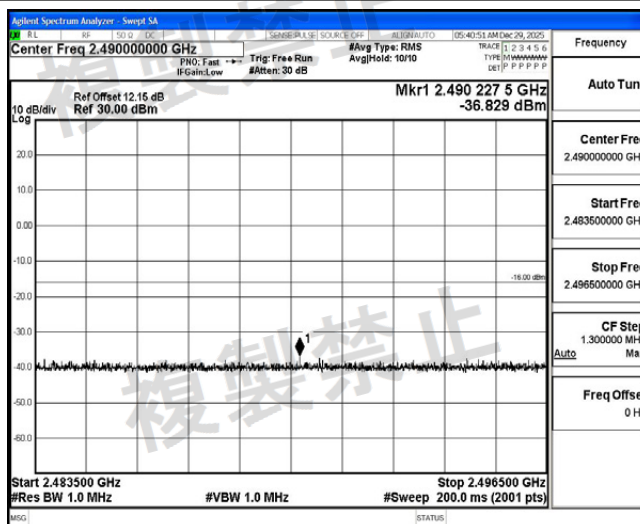





NTHV_3DH5_Ant1_2441_2496.5~13000



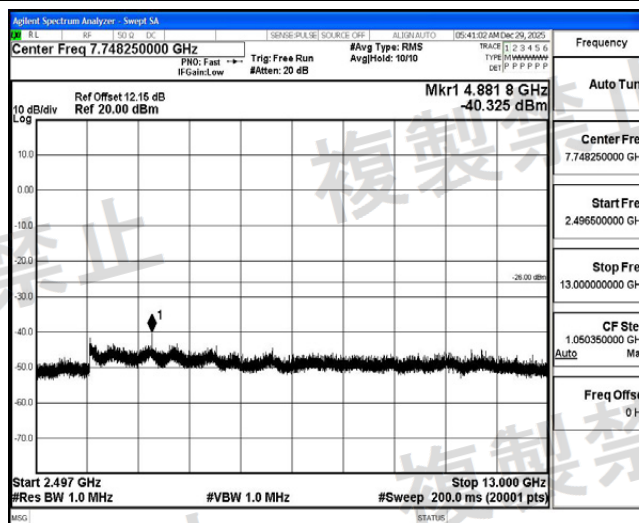


NTHV_3DH5_Ant1_2480_30~1000

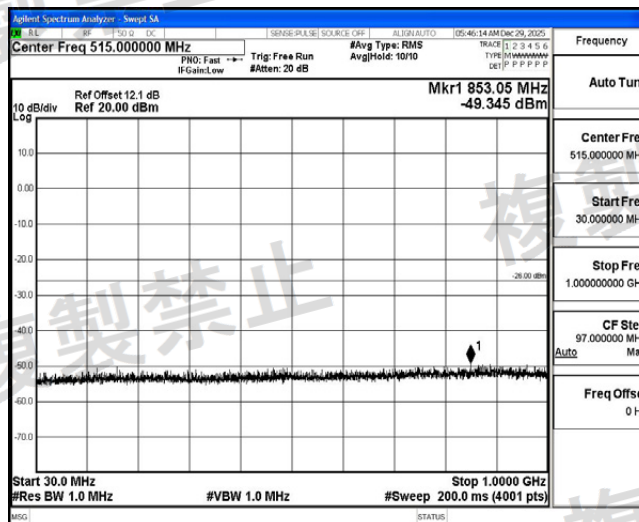

NTHV_3DH5_Ant1_2480_1000~2387

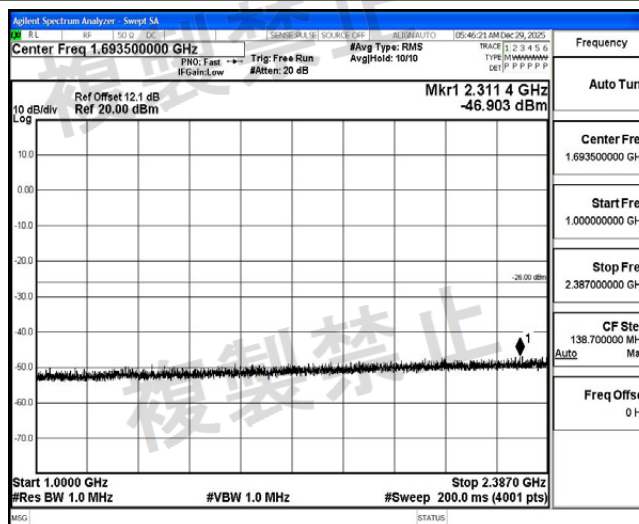



**Appendix G: Spurious Emission of RX****Test Result 1**

Test Condition	Test Mode	Antenna	Freq(M Hz)	Freq.Range [MHz]	Freq. [MHz]	Result [dBm]	Limit [dBm]	Result [nW]	Limit [nW]	Verdict
NTNV	DH5	Ant1	2402	30~1000	249.71	-80.43	≤-54	0.00906	≤4	PASS
				1000~12500	3695.03	-63.07	≤-47	0.49317	≤20	PASS
			2441	30~1000	809.40	-79.64	≤-54	0.01086	≤4	PASS
				1000~12500	3636.95	-62.66	≤-47	0.54200	≤20	PASS
			2480	30~1000	348.65	-54.42	≤-54	3.61410	≤4	PASS
				1000~12500	4855.38	-63.03	≤-47	0.49774	≤20	PASS
	2DH5	Ant1	2402	30~1000	348.65	-79.56	≤-54	0.01107	≤4	PASS
				1000~12500	4032.55	-63.13	≤-47	0.48641	≤20	PASS
			2441	30~1000	349.62	-79.30	≤-54	0.01175	≤4	PASS
				1000~12500	3623.73	-62.97	≤-47	0.50466	≤20	PASS
			2480	30~1000	900.09	-80.55	≤-54	0.00881	≤4	PASS
				1000~12500	4849.05	-63.61	≤-47	0.43551	≤20	PASS
	3DH5	Ant1	2402	30~1000	348.65	-79.59	≤-54	0.01099	≤4	PASS
				1000~12500	3600.15	-62.80	≤-47	0.52481	≤20	PASS
			2441	30~1000	348.65	-77.57	≤-54	0.01750	≤4	PASS
				1000~12500	4714.50	-62.55	≤-47	0.55590	≤20	PASS
			2480	30~1000	249.71	-80.33	≤-54	0.00927	≤4	PASS
				1000~12500	4845.03	-62.83	≤-47	0.52119	≤20	PASS
NTLV	DH5	Ant1	2402	30~1000	349.13	-79.57	≤-54	0.01104	≤4	PASS
				1000~12500	3613.38	-62.90	≤-47	0.51286	≤20	PASS
			2441	30~1000	866.63	-80.10	≤-54	0.00977	≤4	PASS
				1000~12500	3625.45	-62.51	≤-47	0.56105	≤20	PASS
			2480	30~1000	349.62	-78.45	≤-54	0.01429	≤4	PASS
				1000~12500	3638.68	-63.05	≤-47	0.49545	≤20	PASS
	2DH5	Ant1	2402	30~1000	953.93	-80.44	≤-54	0.00904	≤4	PASS
				1000~12500	3658.23	-62.99	≤-47	0.50234	≤20	PASS
			2441	30~1000	349.62	-80.27	≤-54	0.00940	≤4	PASS
				1000~12500	4138.93	-63.30	≤-47	0.46774	≤20	PASS
			2480	30~1000	348.65	-79.02	≤-54	0.01253	≤4	PASS
				1000~12500	3694.45	-63.09	≤-47	0.49091	≤20	PASS
	3DH5	Ant1	2402	30~1000	350.10	-79.30	≤-54	0.01175	≤4	PASS
				1000~12500	6072.08	-62.95	≤-47	0.50699	≤20	PASS
			2441	30~1000	348.65	-79.11	≤-54	0.01227	≤4	PASS
				1000~12500	4801.33	-63.08	≤-47	0.49204	≤20	PASS
			2480	30~1000	348.65	-59.15	≤-54	1.21619	≤4	PASS
				1000~12500	4834.10	-62.74	≤-47	0.53211	≤20	PASS
NTHV	DH5	Ant1	2402	30~1000	900.09	-80.17	≤-54	0.00962	≤4	PASS
				1000~12500	4850.78	-63.28	≤-47	0.46989	≤20	PASS

Dongguan DN Testing Co., Ltd.

Add: No. 1, West Fourth Street, Xingfa South Road, Wusha Community, Chang'an Town, Dongguan City, Guangdong P.R.China

Web: www.dn-testing.com

Tel: +86-769-88087383

E-mail: service@dn-testing.com



		2441	30~1000	902.03	-80.36	≤-54	0.00920	≤4	PASS
			1000~12500	4910.58	-62.73	≤-47	0.53333	≤20	PASS
		2480	30~1000	797.27	-80.16	≤-54	0.00964	≤4	PASS
			1000~12500	3615.10	-62.48	≤-47	0.56494	≤20	PASS
	2DH5	2402	30~1000	953.44	-80.78	≤-54	0.00836	≤4	PASS
			1000~12500	3601.88	-62.31	≤-47	0.58749	≤20	PASS
		2441	30~1000	921.92	-80.53	≤-54	0.00885	≤4	PASS
			1000~12500	4856.53	-61.79	≤-47	0.66222	≤20	PASS
		2480	30~1000	348.65	-79.97	≤-54	0.01007	≤4	PASS
			1000~12500	3612.80	-63.27	≤-47	0.47098	≤20	PASS
	3DH5	2402	30~1000	519.37	-79.49	≤-54	0.01125	≤4	PASS
			1000~12500	3641.55	-61.91	≤-47	0.64417	≤20	PASS
		2441	30~1000	348.65	-76.90	≤-54	0.02042	≤4	PASS
			1000~12500	3617.40	-62.26	≤-47	0.59429	≤20	PASS
		2480	30~1000	348.65	-79.87	≤-54	0.01030	≤4	PASS
			1000~12500	4788.10	-63.35	≤-47	0.46238	≤20	PASS

Test Result 2


Test Condition	Test Mode	Antenna	Freq(M Hz)	Freq. [MHz]	Result [dBm]	Limit [dBm]	Result [nW]	Limit [nW]	Verdict
NTNV	DH5	Ant1	2480	348.65	-86.71	≤-54	0.00213	≤4	PASS
NTLV	3DH5	Ant1	2480	348.65	-85.69	≤-54	0.00270	≤4	PASS

Note: Both left and right earphone have tested, The right earphone is the worst, only the worse case was reported.




Test Graphs 1


NTNV_DH5_Ant1_2402_30~1000

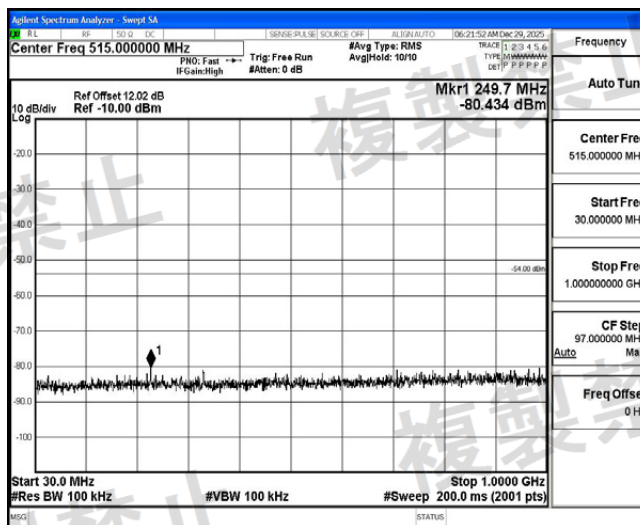

NTNV_DH5_Ant1_2402_1000~12500

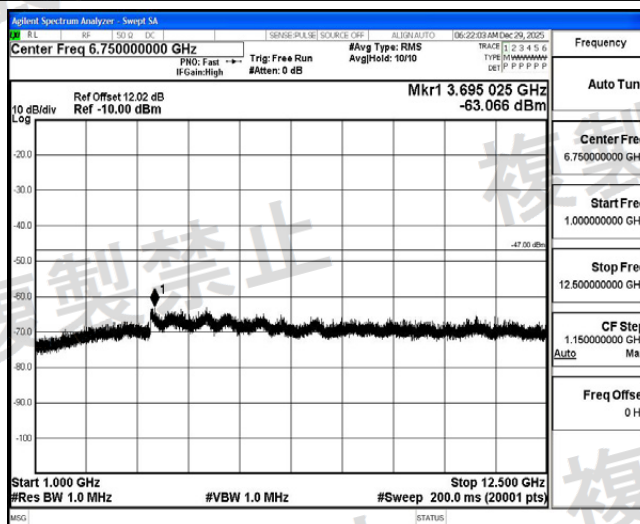


NTNV_DH5_Ant1_2441_30~1000

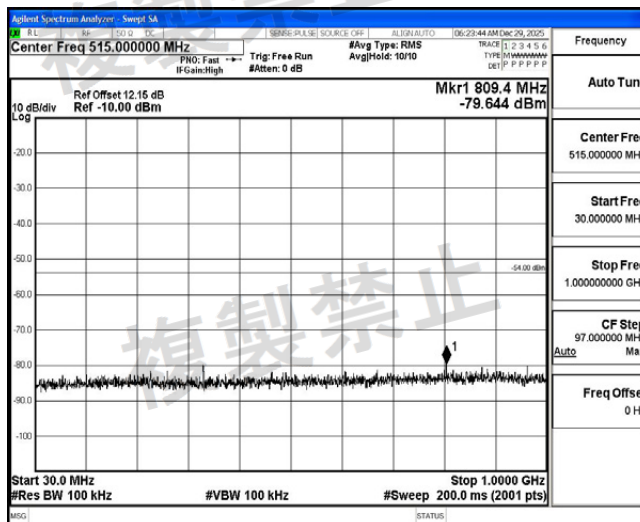





NTNV_DH5_Ant1_2441_1000~12500

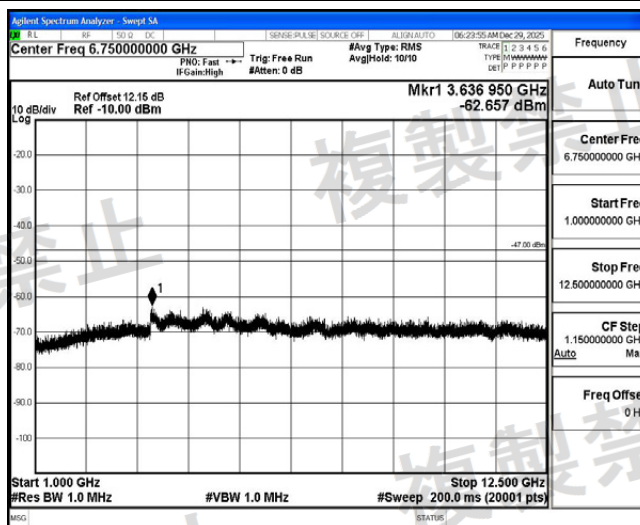

NTNV_DH5_Ant1_2480_30~1000

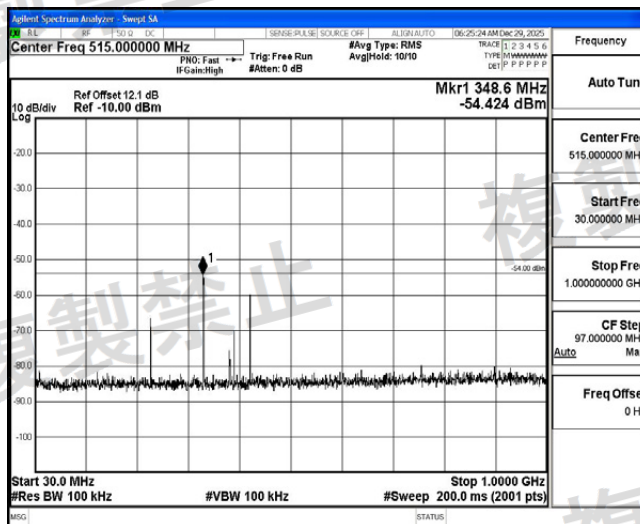


NTNV_DH5_Ant1_2480_1000~12500

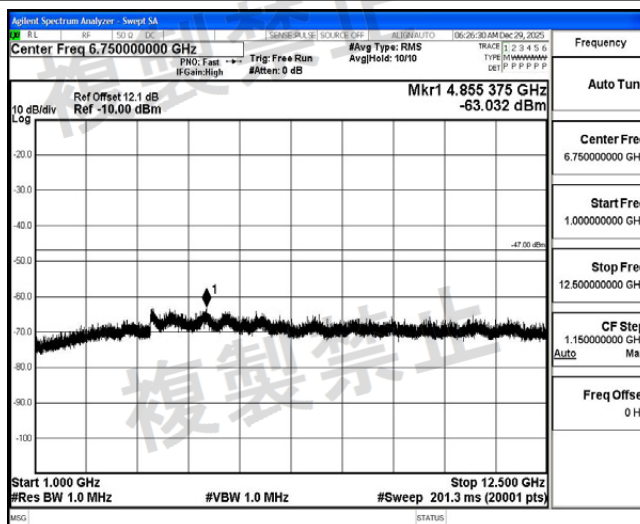





NTNV_2DH5_Ant1_2402_30~1000

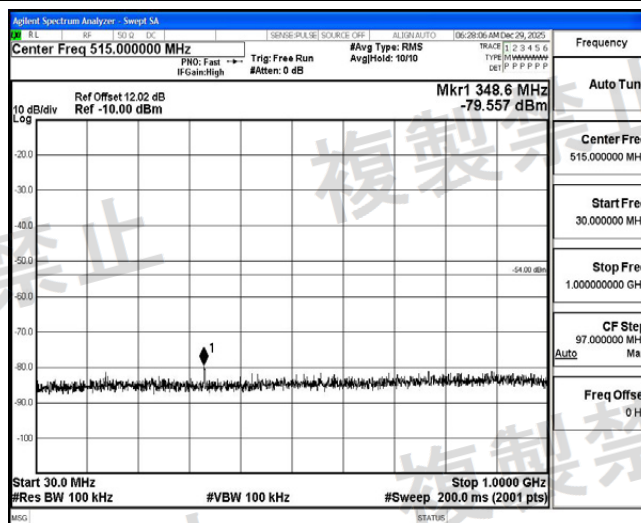

NTNV_2DH5_Ant1_2402_1000~12500

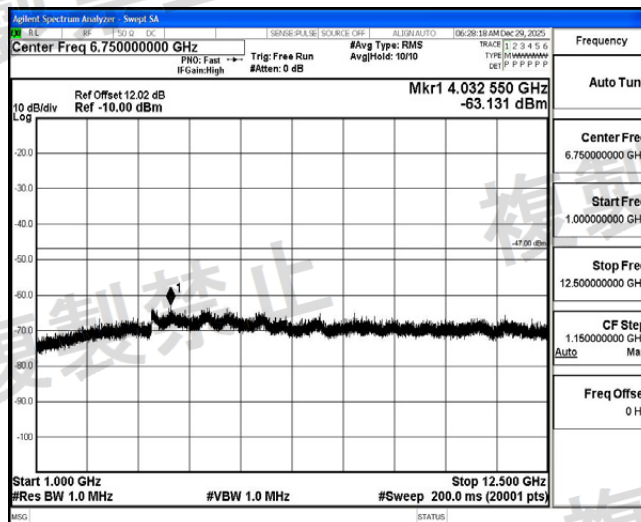


NTNV_2DH5_Ant1_2441_30~1000

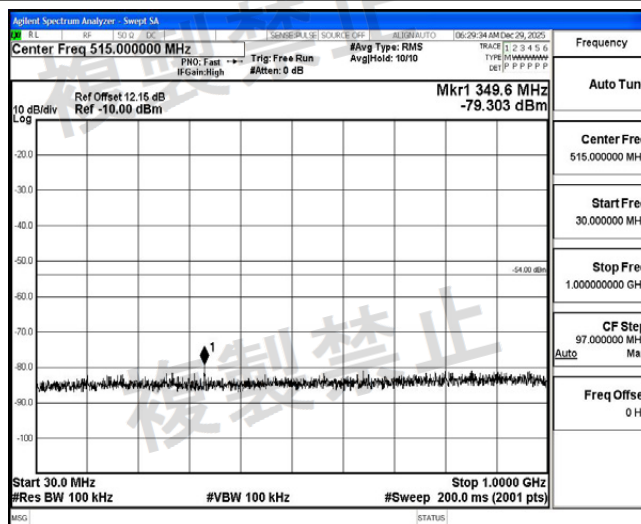





NTNV_2DH5_Ant1_2441_1000~12500

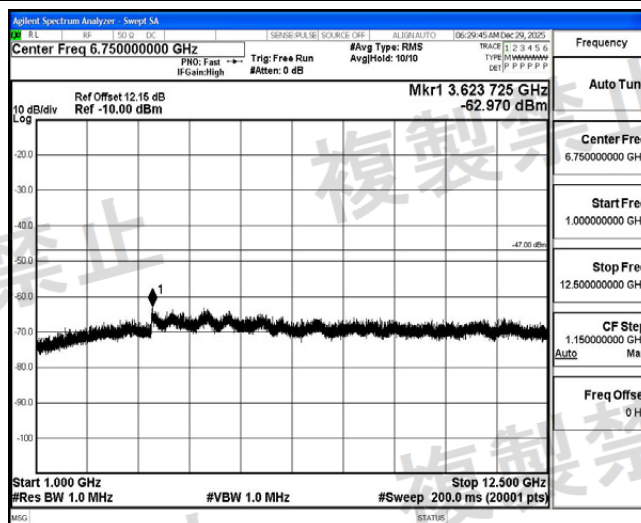

NTNV_2DH5_Ant1_2480_30~1000

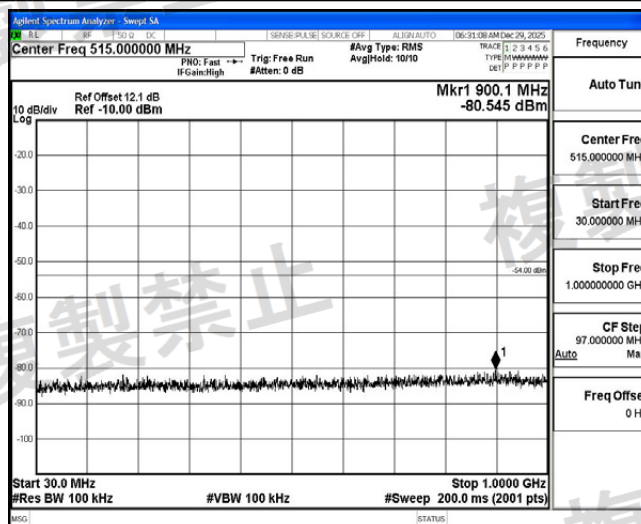


NTNV_2DH5_Ant1_2480_1000~12500

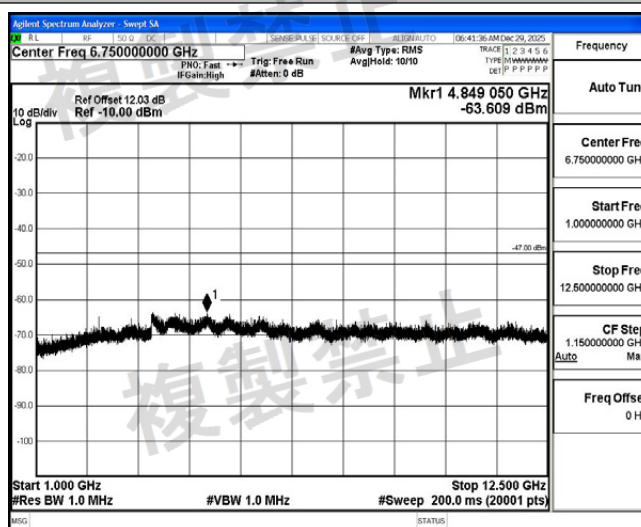





NTNV_3DH5_Ant1_2402_30~1000

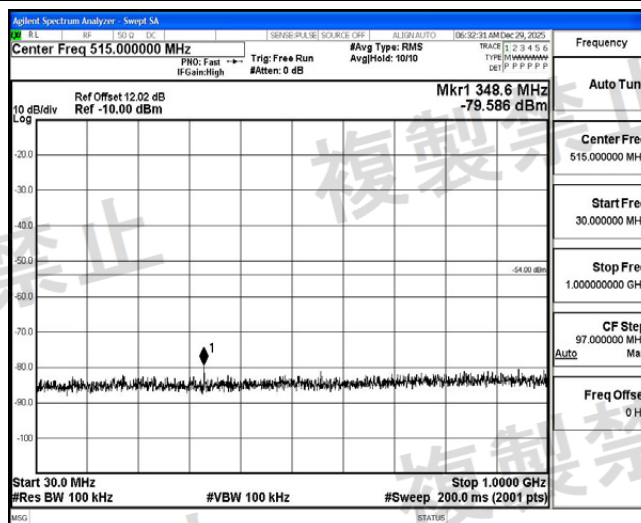

NTNV_3DH5_Ant1_2402_1000~12500

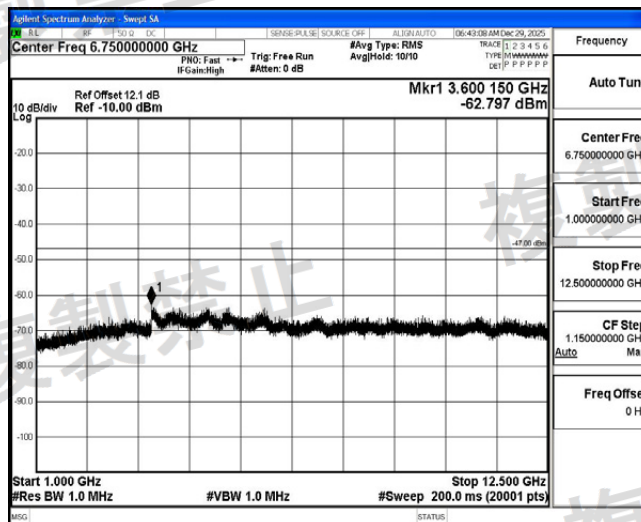


NTNV_3DH5_Ant1_2441_30~1000

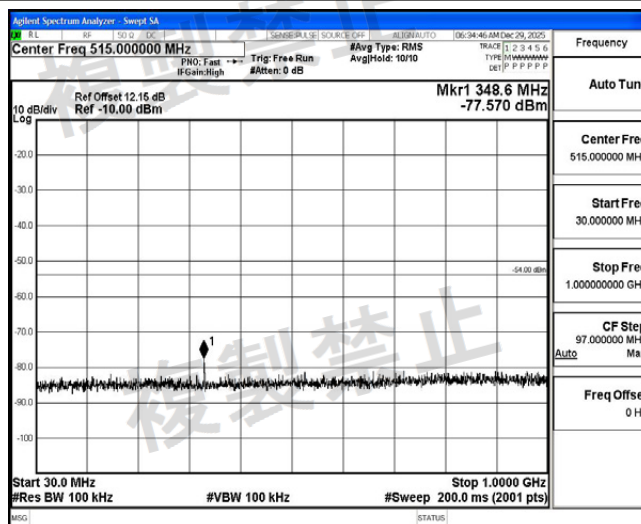





NTNV_3DH5_Ant1_2441_1000~12500

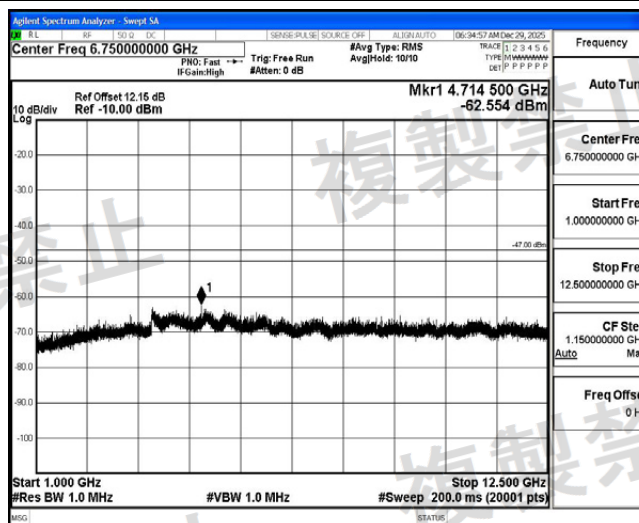

NTNV_3DH5_Ant1_2480_30~1000

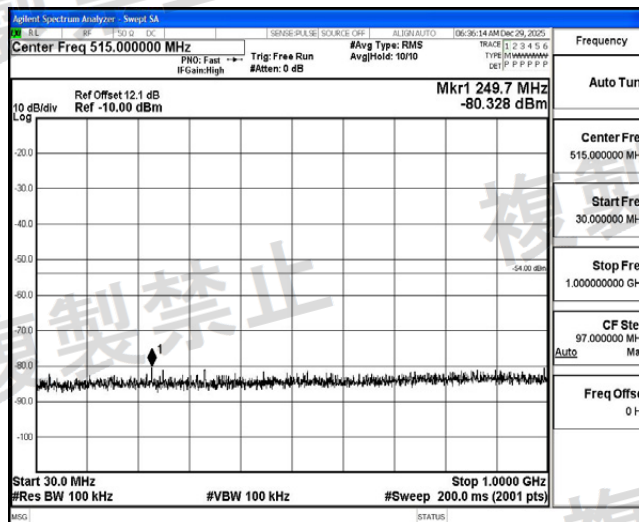


NTNV_3DH5_Ant1_2480_1000~12500

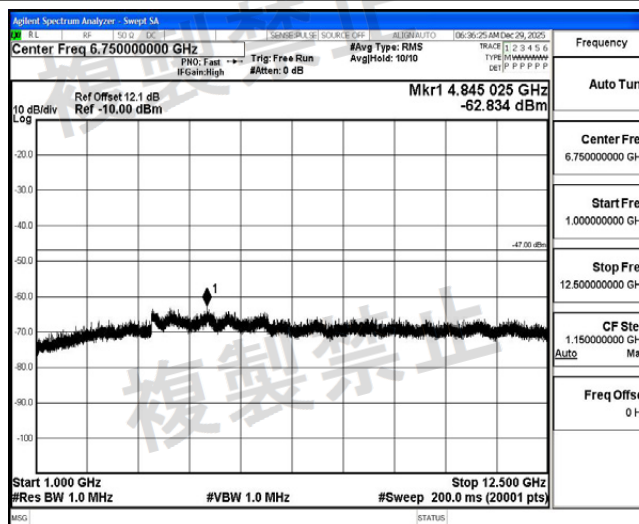





NTLV_DH5_Ant1_2402_30~1000

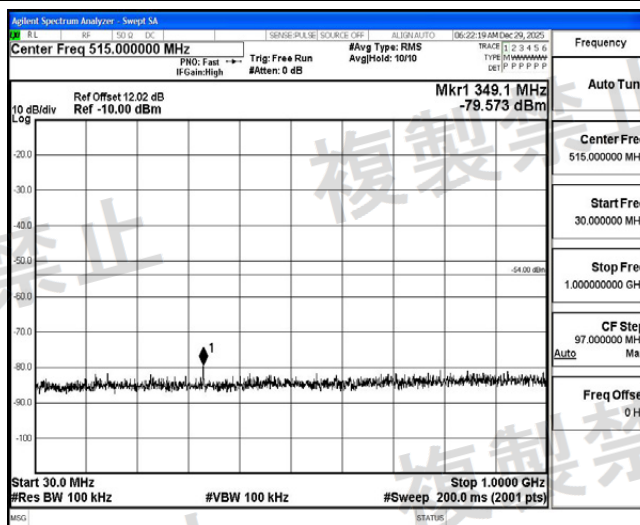

NTLV_DH5_Ant1_2402_1000~12500

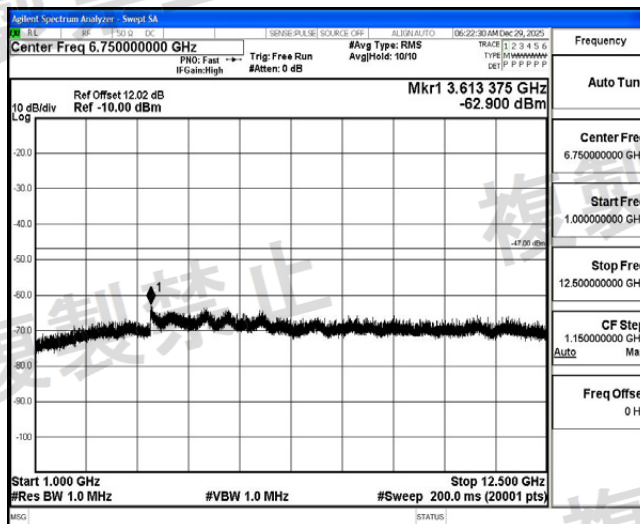


NTLV_DH5_Ant1_2441_30~1000

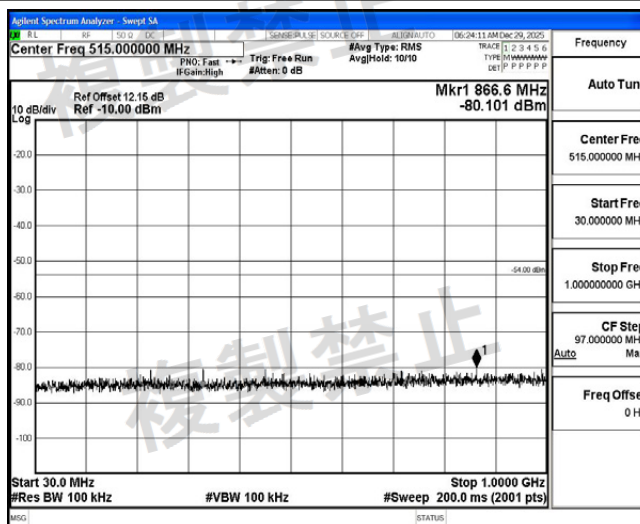





NTLV_DH5_Ant1_2441_1000~12500

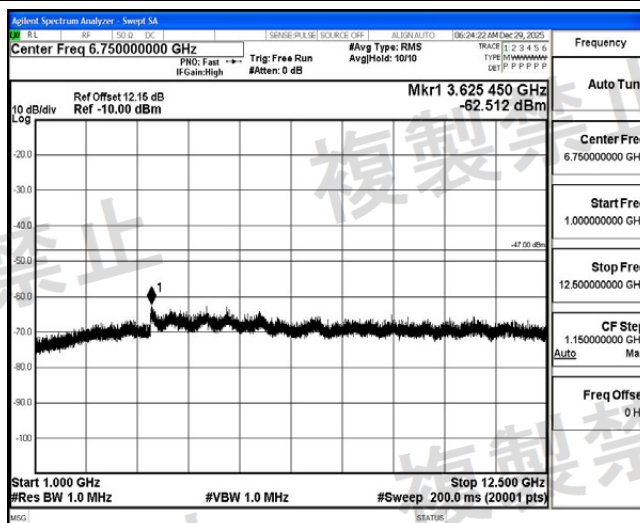

NTLV_DH5_Ant1_2480_30~1000

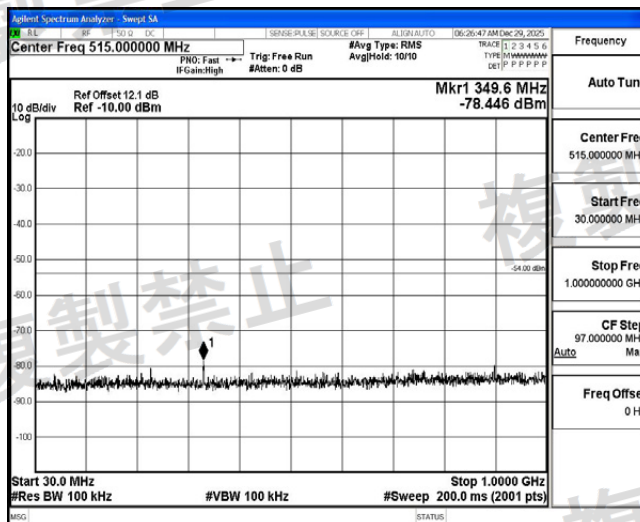


NTLV_DH5_Ant1_2480_1000~12500

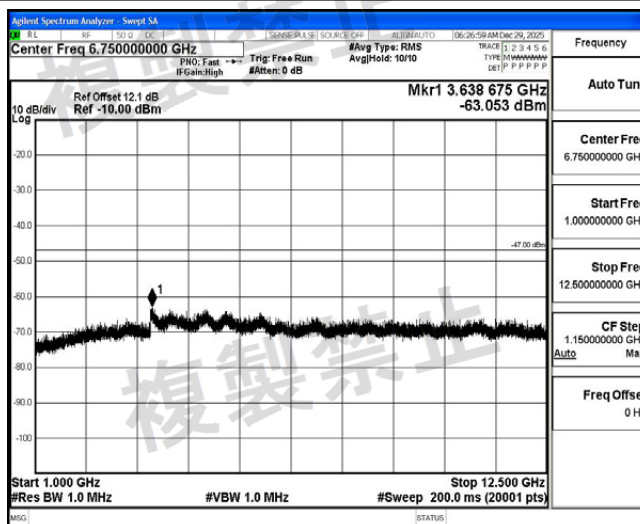





NTLV_2DH5_Ant1_2402_30~1000

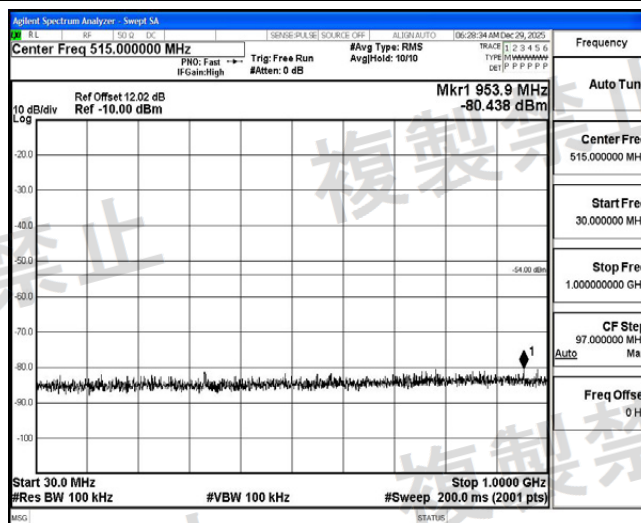

NTLV_2DH5_Ant1_2402_1000~12500

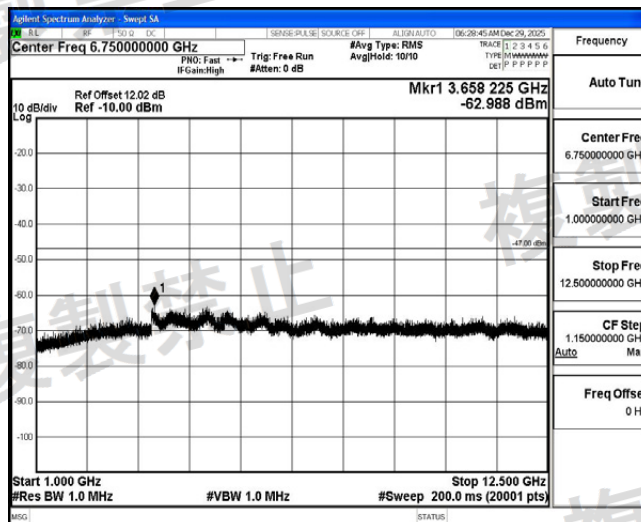


NTLV_2DH5_Ant1_2441_30~1000

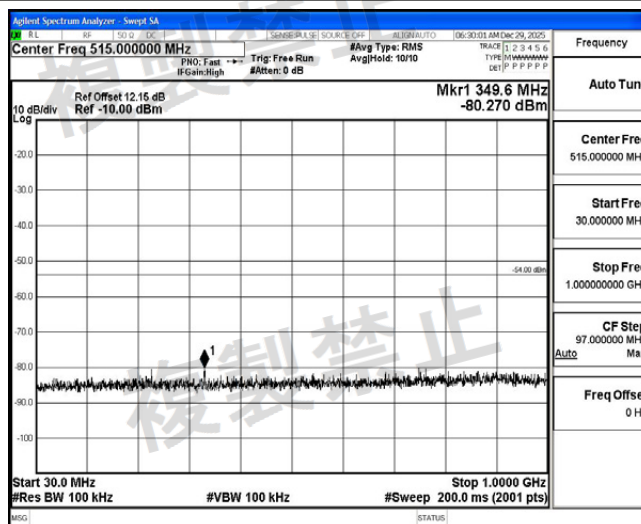





NTLV_2DH5_Ant1_2441_1000~12500

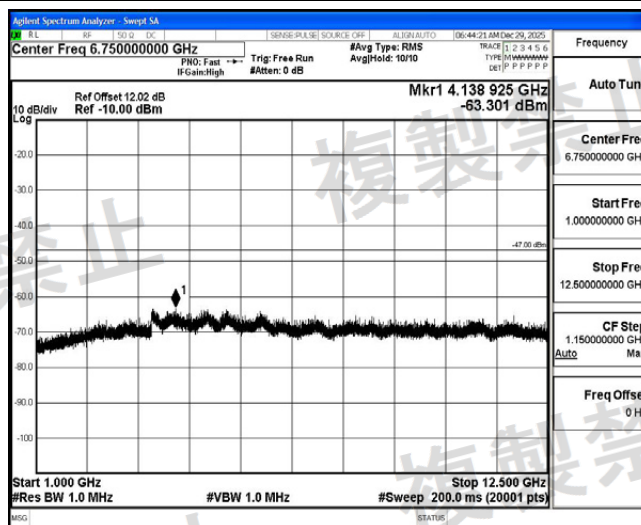

NTLV_2DH5_Ant1_2480_30~1000

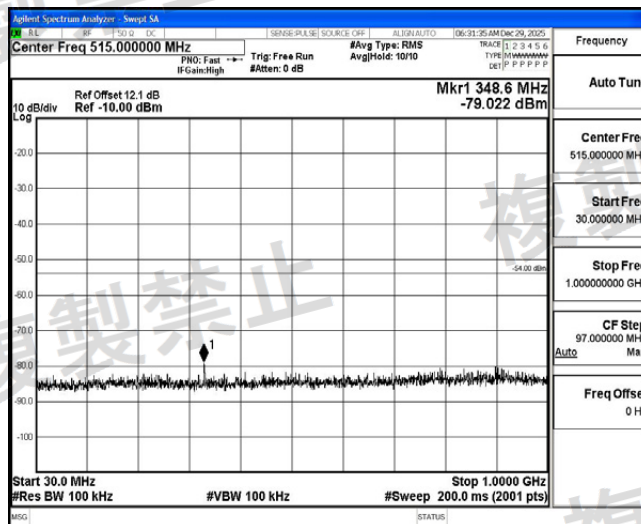


NTLV_2DH5_Ant1_2480_1000~12500

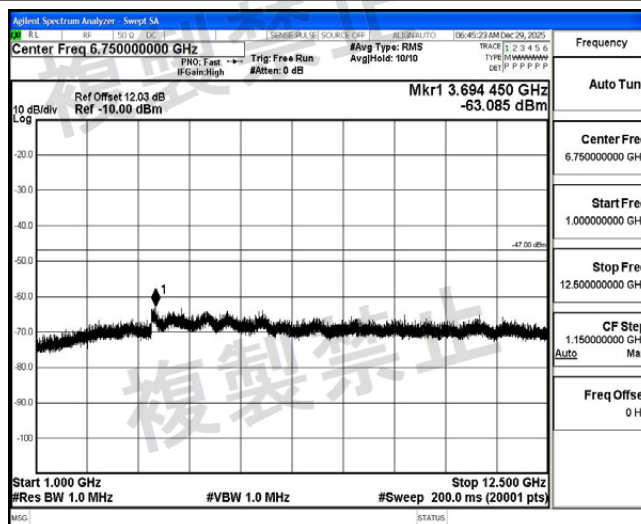





NTLV_3DH5_Ant1_2402_30~1000

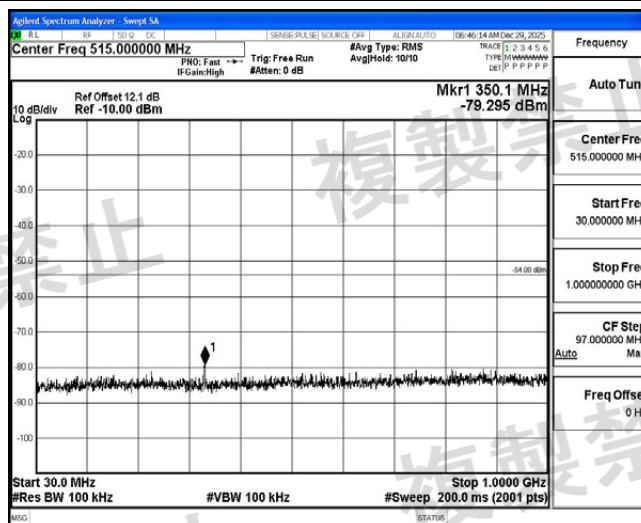

NTLV_3DH5_Ant1_2402_1000~12500

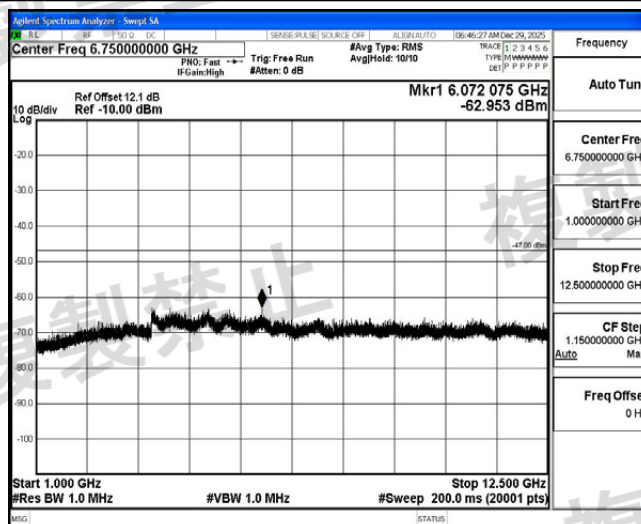


NTLV_3DH5_Ant1_2441_30~1000

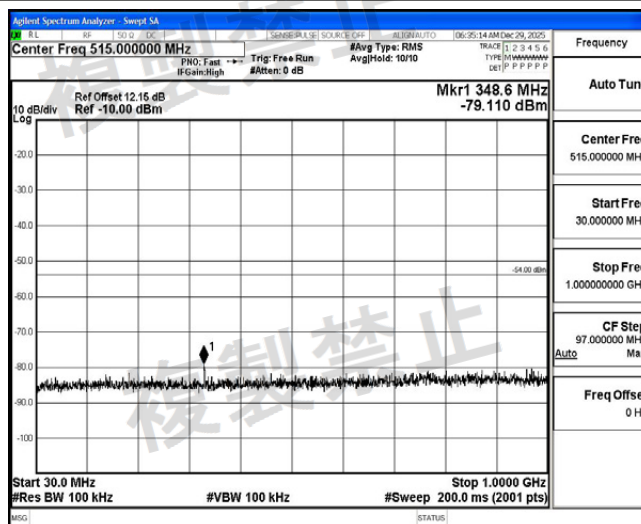





NTLV_3DH5_Ant1_2441_1000~12500

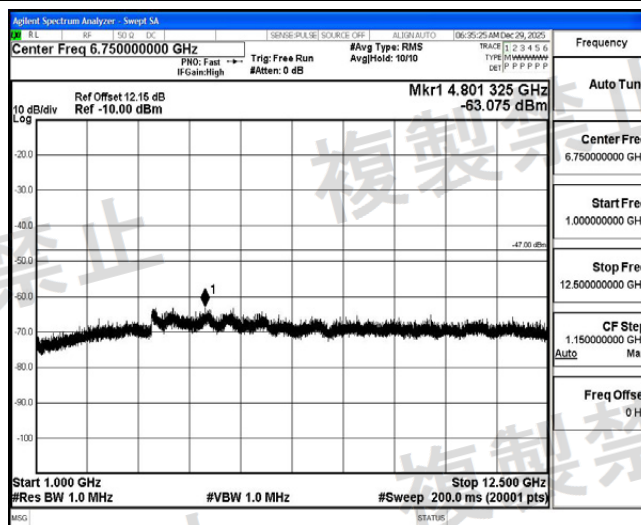

NTLV_3DH5_Ant1_2480_30~1000

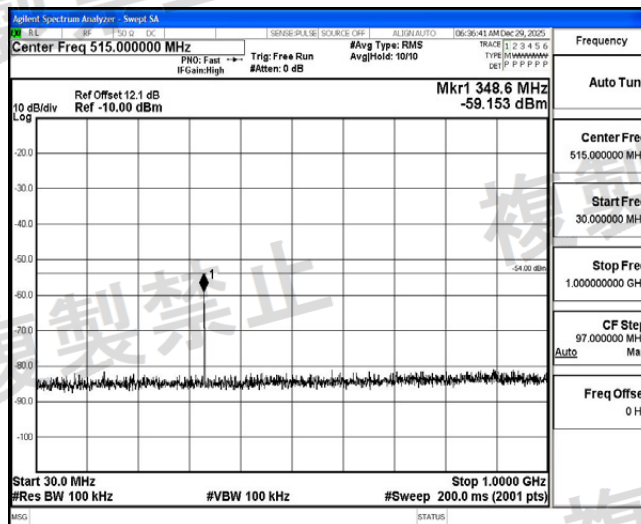


NTLV_3DH5_Ant1_2480_1000~12500

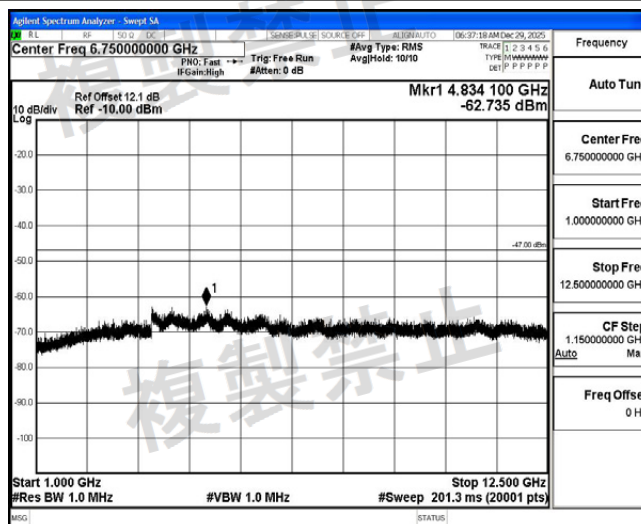





NTHV_DH5_Ant1_2402_30~1000

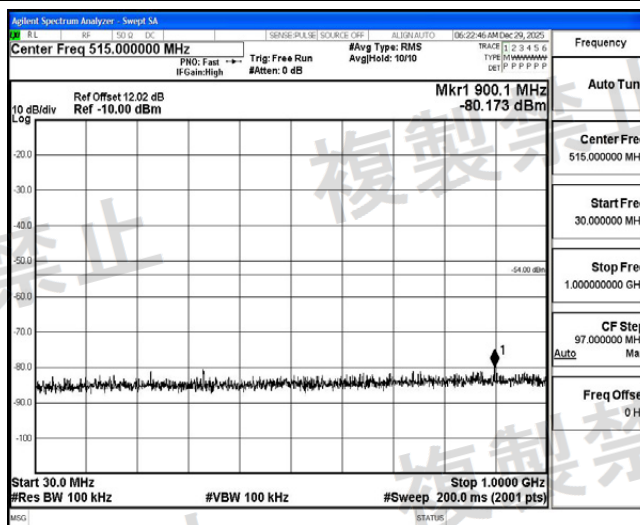

NTHV_DH5_Ant1_2402_1000~12500

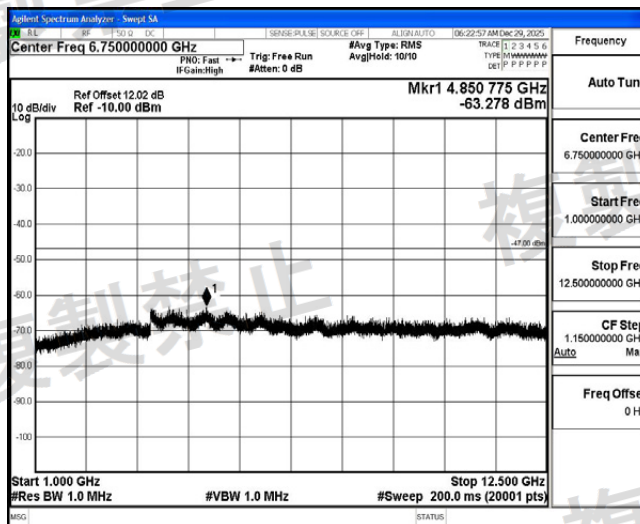


NTHV_DH5_Ant1_2441_30~1000

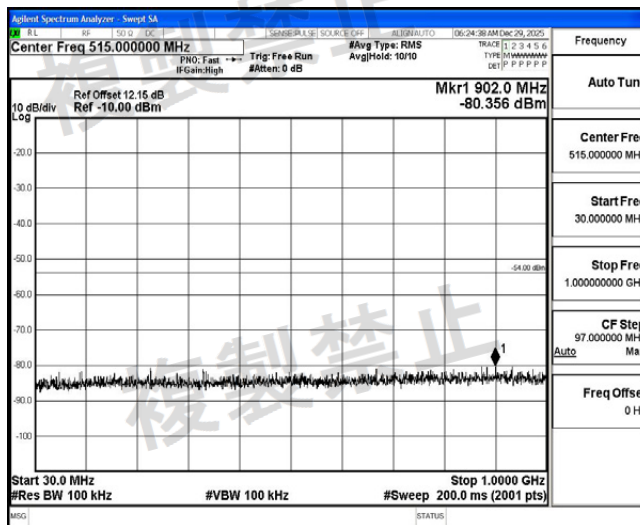





NTHV_DH5_Ant1_2441_1000~12500

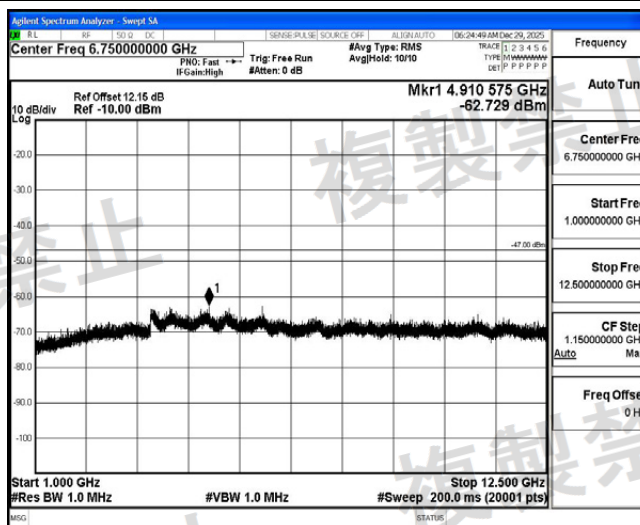

NTHV_DH5_Ant1_2480_30~1000

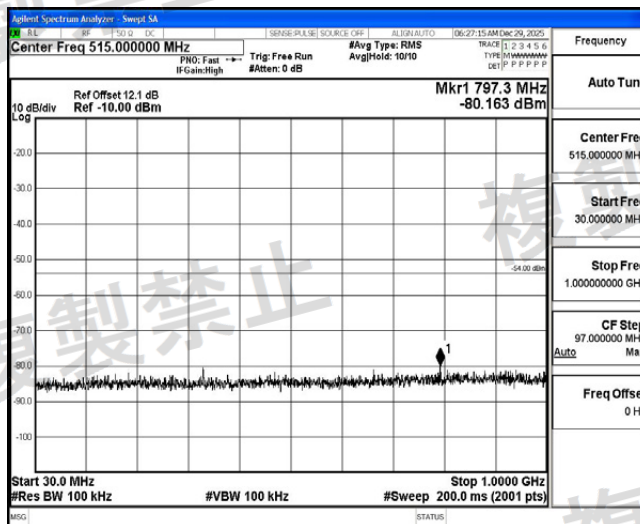


NTHV_DH5_Ant1_2480_1000~12500

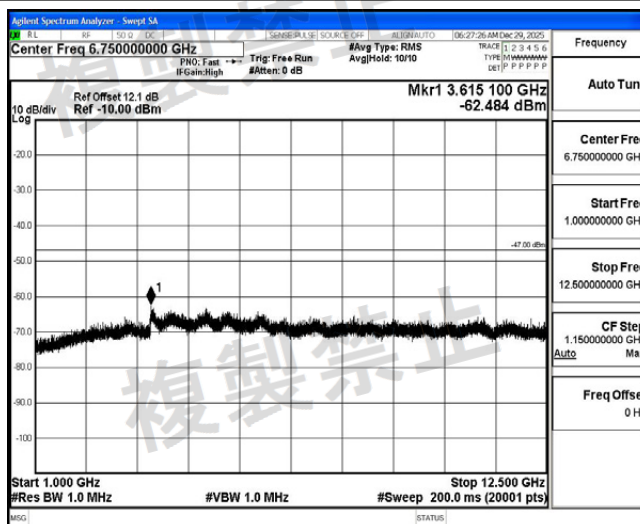





NTHV_2DH5_Ant1_2402_30~1000

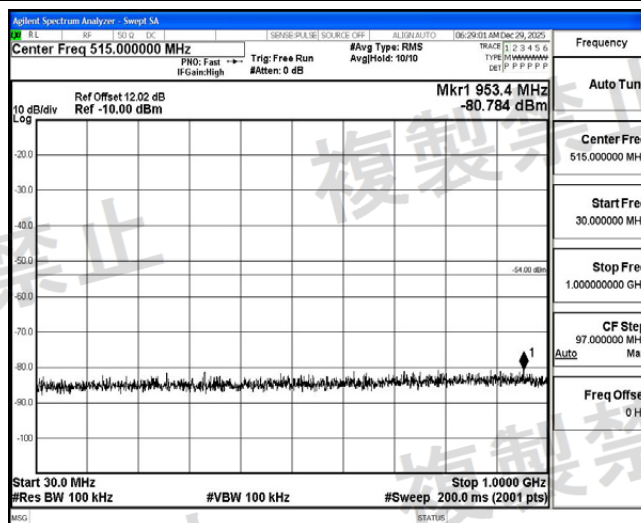

NTHV_2DH5_Ant1_2402_1000~12500

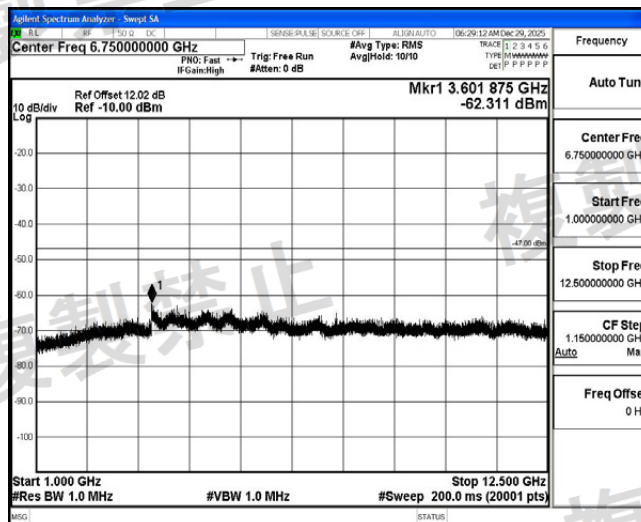


NTHV_2DH5_Ant1_2441_30~1000

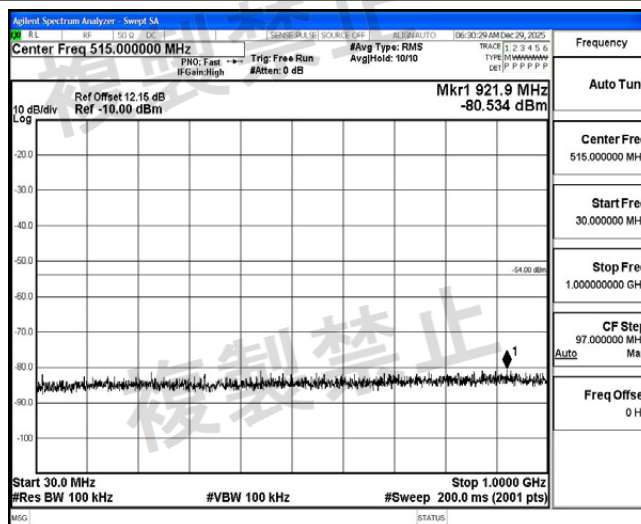





NTHV_2DH5_Ant1_2441_1000~12500

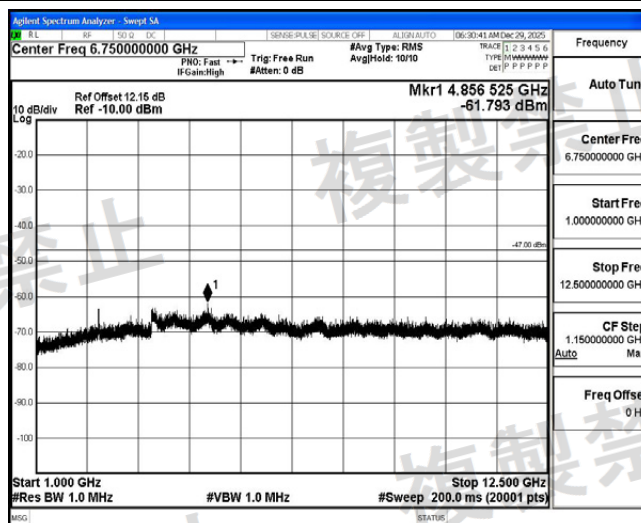

NTHV_2DH5_Ant1_2480_30~1000

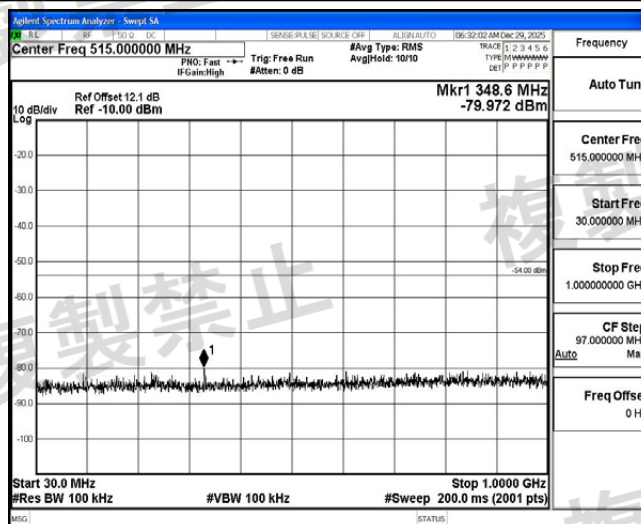


NTHV_2DH5_Ant1_2480_1000~12500

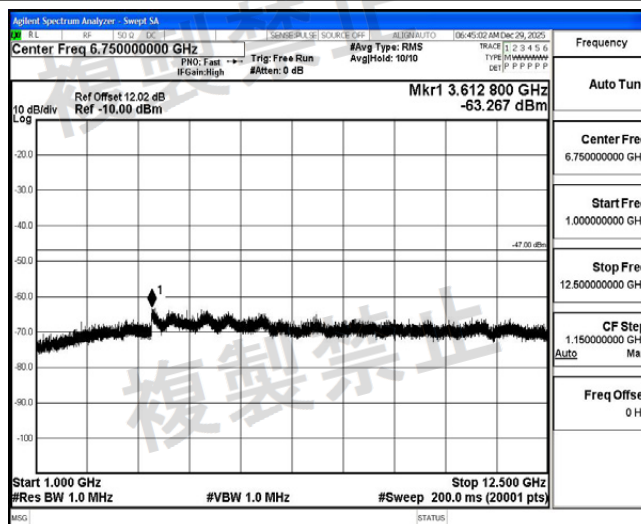





NTHV_3DH5_Ant1_2402_30~1000

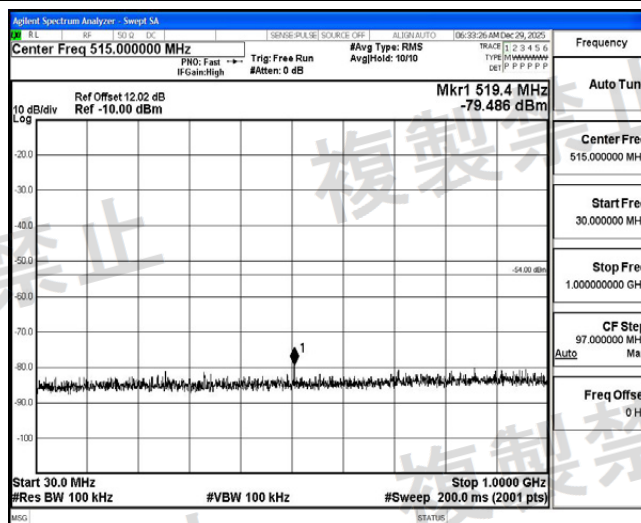

NTHV_3DH5_Ant1_2402_1000~12500

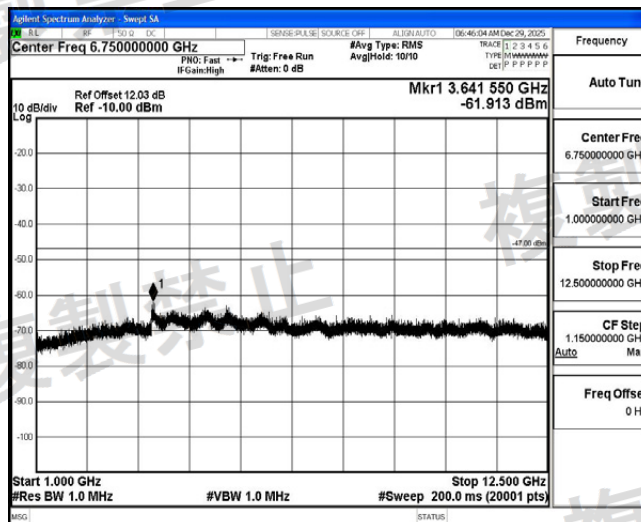


NTHV_3DH5_Ant1_2441_30~1000

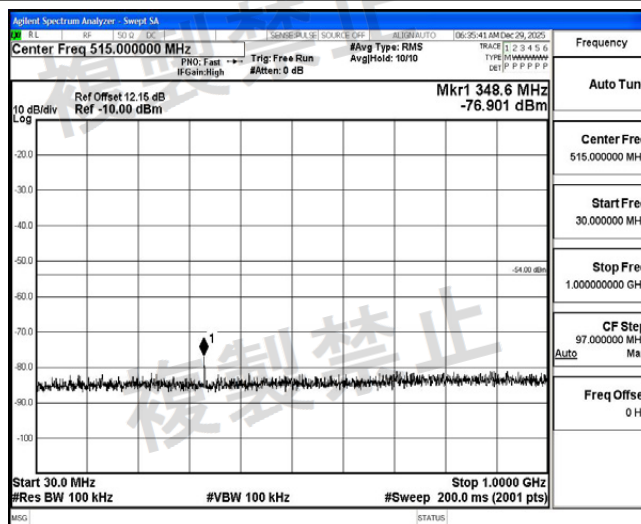





NTHV_3DH5_Ant1_2441_1000~12500

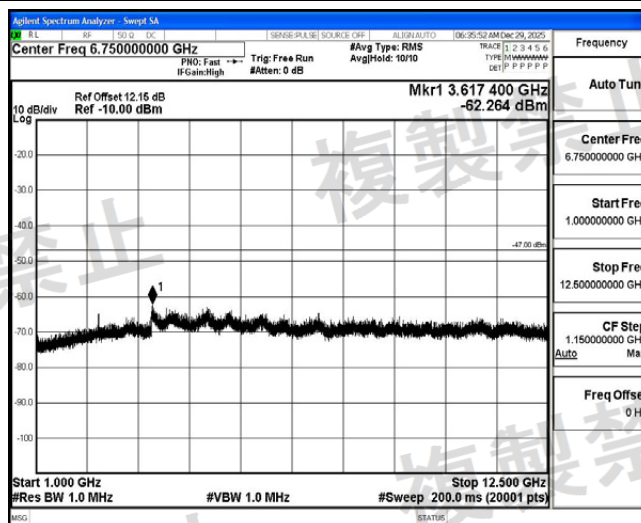

NTHV_3DH5_Ant1_2480_30~1000

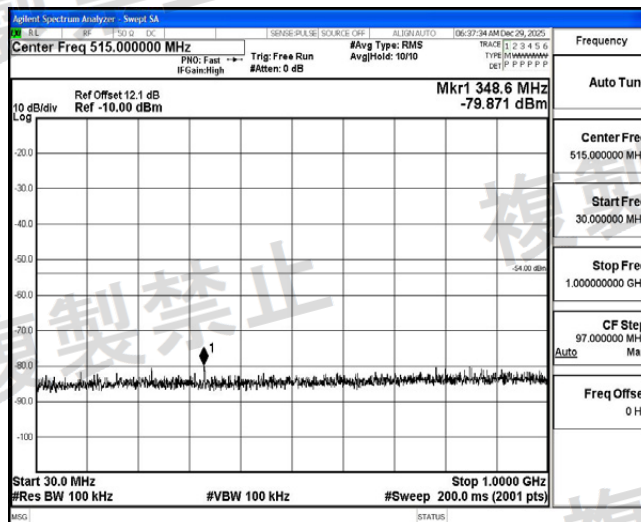



NTHV_3DH5_Ant1_2480_1000~12500

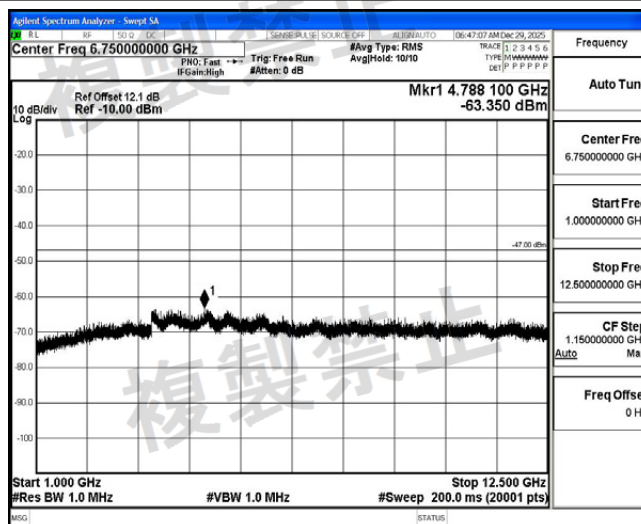





Test Graphs 2

NTNV_DH5_Ant1_2480_348.65

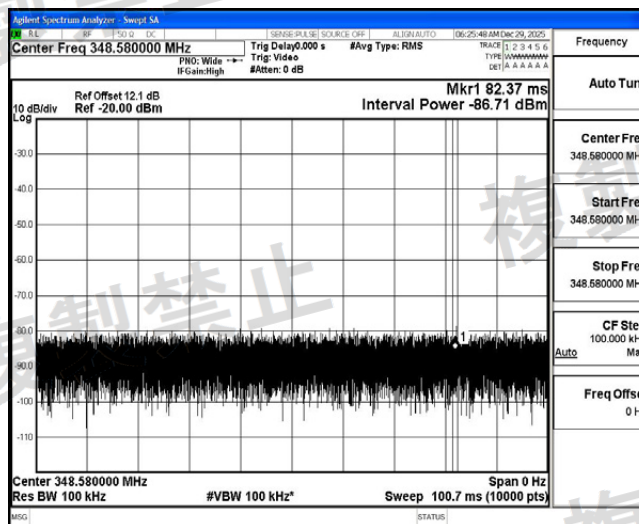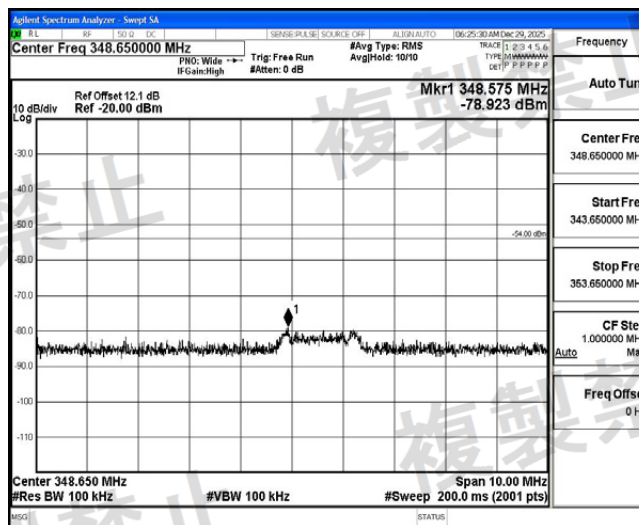

NTLV_3DH5_Ant1_2480_348.65

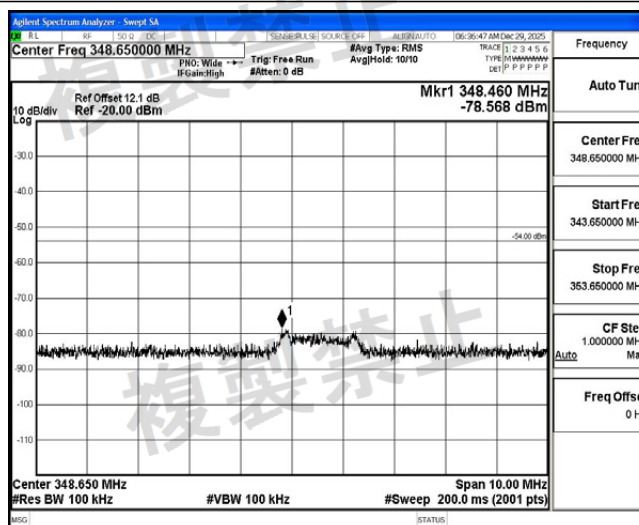

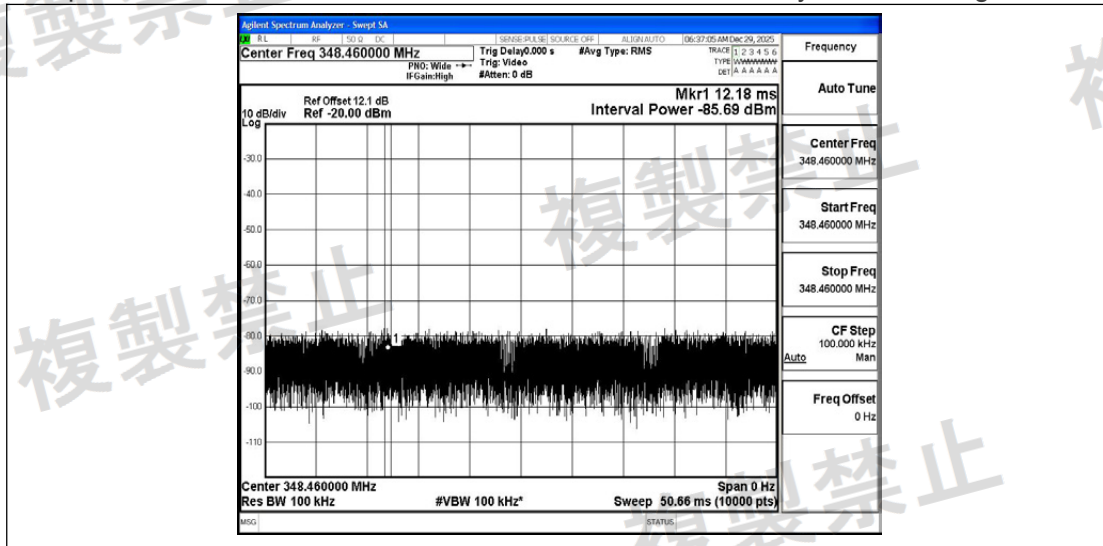

---END REPORT---