



8. Antenna Power and E.I.R.P. and Antenna Power Tolerance

8.1 Limit

For 5.2 GHz Band:

Item	Limits			
	20MHz	40MHz	80MHz	160MHz
Antenna Power	10mW/MHz	5mW/MHz	2.5mW/MHz	1.25mW/MHz
E.I.R.P.	10mW/MHz	5mW/MHz	2.5mW/MHz	1.25mW/MHz
Antenna Power Tolerance	+20%, -80%			

For 5.3 GHz Band:

Item	Limits			
	20MHz	40MHz	80MHz	160MHz
Antenna Power	10mW/MHz	5mW/MHz	2.5mW/MHz	1.25mW/MHz
E.I.R.P.	10mW/MHz: with TPC	5mW/MHz: with TPC	2.5mW/MHz: with TPC	1.25mW/MHz: with TPC
	5mW/MHz: without TPC	2.5mW/MHz: without TPC	1.25mW/MHz: without TPC	0.625mW/MHz: without TPC
Antenna Power Tolerance	+20%, -80%			

For 5.6 GHz Band:

Item	Limits			
	20MHz	40MHz	80MHz	160MHz
Antenna Power	10mW/MHz	5mW/MHz	2.5mW/MHz	1.25mW/MHz
E.I.R.P.	50mW/MHz: with TPC	25mW/MHz: with TPC	12.5mW/MHz: with TPC	6.25mW/MHz: with TPC
	25mW/MHz: without TPC	12.5mW/MHz: without TPC	6.25mW/MHz: without TPC	3.125mW/MHz: without TPC
Antenna Power Tolerance	+50%, -50%			

8.2 Measurement Procedure

- Set EUT work in test mode as described in clause 2.4.
- Connected the EUT's antenna port to the Spectrum Analyzer by suitable attenuator, set the Spectrum Analyzer as below:
 - Centre Frequency: The center frequency of the channel under test.
 - Resolution BW: 1MHz.
 - Video BW: 3MHz.
 - Span: Wide enough to cover the complete power envelope of the signal of the EUT.
 - Trigger condition: Free run.
 - Sweep mode: Continuous sweeping.
 - Detector: Peak.
 - Trace Mode: Max Hold.
- When the trace is complete, find the peak value of the power envelope and record.
- Make the following changes to the setting of the Spectrum Analyzer:
 - Centre Frequency: Equal to the frequency recorded in step c
 - Resolution BW: 1MHz.
 - Video BW: 3MHz.
 - Span: 0MHz
 - Trigger condition: Free run.
 - Sweep mode: Continuous sweeping.
 - Detector: Average
 - Trace Mode: Max Hold.


When the trace is complete, find the peak value (value "A" in dBm) of the power envelope and record.

 - Add the (stated) antenna assembly gain "G" in dBi of the individual antenna.
 - If applicable, add the additional beamforming gain "Y" in dB.

The equivalent isotropically radiated power (P) shall be calculated using the formula below:

$$P = A + G + Y$$

8.3 Test Setup

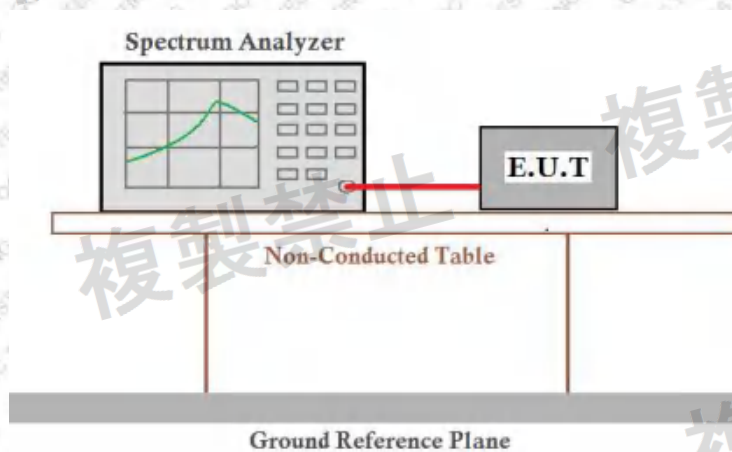

8.4 Test Data

Temperature	25 °C	Humidity	55 %
ATM Pressure	101.1kPa	Antenna Gain	See page 5
Test by	Fan Yang	Test result	PASS

Please refer to following table.



Normal Voltage

W52:

Antenna Power

Mode	Freq. (MHz)	Ant.	Power (dBm/MHz)	Power (mW/MHz)	Limit (mW/MHz)	Declared Power (mW/MHz)	Tolerance (%)	Lower Limit (%)	Upper Limit (%)	Verdict
a	5180	Ant1	-0.64	0.863	10	2	-56.85	-80	20	Pass
a	5180	Ant2	-1.43	0.719	10	2	-64.05	-80	20	Pass
a	5180	Sum	1.99	1.582	10	2	-20.90	-80	20	Pass
a	5200	Ant1	-0.33	0.927	10	2	-53.65	-80	20	Pass
a	5200	Ant2	-1.08	0.78	10	2	-61.00	-80	20	Pass
a	5200	Sum	2.32	1.707	10	2	-14.65	-80	20	Pass
a	5240	Ant1	-1.63	0.687	10	2	-65.65	-80	20	Pass
a	5240	Ant2	-2.26	0.594	10	2	-70.30	-80	20	Pass
a	5240	Sum	1.08	1.281	10	2	-35.95	-80	20	Pass
n20	5180	Ant1	-0.62	0.867	10	1.5	-42.20	-80	20	Pass
n20	5180	Ant2	-1.68	0.679	10	1.5	-54.73	-80	20	Pass
n20	5180	Sum	1.89	1.546	10	1.5	3.07	-80	20	Pass
n20	5200	Ant1	-0.84	0.824	10	1.5	-45.07	-80	20	Pass
n20	5200	Ant2	-1.59	0.693	10	1.5	-53.80	-80	20	Pass
n20	5200	Sum	1.81	1.517	10	1.5	1.13	-80	20	Pass
n20	5240	Ant1	-1.8	0.661	10	1.5	-55.93	-80	20	Pass
n20	5240	Ant2	-2.65	0.543	10	1.5	-63.80	-80	20	Pass
n20	5240	Sum	0.81	1.204	10	1.5	-19.73	-80	20	Pass
n40	5190	Ant1	-2.24	0.597	5	1	-40.30	-80	20	Pass
n40	5190	Ant2	-4.15	0.385	5	1	-61.50	-80	20	Pass
n40	5190	Sum	-0.08	0.982	5	1	-1.80	-80	20	Pass
n40	5230	Ant1	-2.58	0.552	5	1	-44.80	-80	20	Pass
n40	5230	Ant2	-4.12	0.387	5	1	-61.30	-80	20	Pass
n40	5230	Sum	-0.27	0.939	5	1	-6.10	-80	20	Pass
ac20	5180	Ant1	-0.74	0.843	10	1.5	-43.80	-80	20	Pass
ac20	5180	Ant2	-1.59	0.693	10	1.5	-53.80	-80	20	Pass
ac20	5180	Sum	1.86	1.536	10	1.5	2.40	-80	20	Pass
ac20	5200	Ant1	-1.03	0.789	10	1.5	-47.40	-80	20	Pass
ac20	5200	Ant2	-1.56	0.698	10	1.5	-53.47	-80	20	Pass
ac20	5200	Sum	1.72	1.487	10	1.5	-0.87	-80	20	Pass
ac20	5240	Ant1	-1.88	0.649	10	1.5	-56.73	-80	20	Pass
ac20	5240	Ant2	-2.75	0.531	10	1.5	-64.60	-80	20	Pass
ac20	5240	Sum	0.72	1.18	10	1.5	-21.33	-80	20	Pass
ac40	5190	Ant1	-2.31	0.587	5	1	-41.30	-80	20	Pass
ac40	5190	Ant2	-4.23	0.378	5	1	-62.20	-80	20	Pass
ac40	5190	Sum	-0.15	0.965	5	1	-3.50	-80	20	Pass
ac40	5230	Ant1	-2.96	0.506	5	1	-49.40	-80	20	Pass
ac40	5230	Ant2	-4.19	0.381	5	1	-61.90	-80	20	Pass



ac40	5230	Sum	-0.52	0.887	5	1	-11.30	-80	20	Pass
ac80	5210	Ant1	-5.99	0.252	2.5	0.5	-49.60	-80	20	Pass
ac80	5210	Ant2	-6.98	0.2	2.5	0.5	-60.00	-80	20	Pass
ac80	5210	Sum	-3.45	0.452	2.5	0.5	-9.60	-80	20	Pass
ax20	5180	Ant1	-4.49	0.356	10	0.6	-40.67	-80	20	Pass
ax20	5180	Ant2	-5.07	0.311	10	0.6	-48.17	-80	20	Pass
ax20	5180	Sum	-1.76	0.667	10	0.6	11.17	-80	20	Pass
ax20	5200	Ant1	-4.97	0.318	10	0.6	-47.00	-80	20	Pass
ax20	5200	Ant2	-5.32	0.294	10	0.6	-51.00	-80	20	Pass
ax20	5200	Sum	-2.13	0.612	10	0.6	2.00	-80	20	Pass
ax20	5240	Ant1	-4.55	0.351	10	0.6	-41.50	-80	20	Pass
ax20	5240	Ant2	-5.62	0.274	10	0.6	-54.33	-80	20	Pass
ax20	5240	Sum	-2.04	0.625	10	0.6	4.17	-80	20	Pass
ax40	5190	Ant1	-7.07	0.196	5	0.3	-34.67	-80	20	Pass
ax40	5190	Ant2	-8.57	0.139	5	0.3	-53.67	-80	20	Pass
ax40	5190	Sum	-4.75	0.335	5	0.3	11.67	-80	20	Pass
ax40	5230	Ant1	-7.07	0.196	5	0.3	-34.67	-80	20	Pass
ax40	5230	Ant2	-8.78	0.132	5	0.3	-56.00	-80	20	Pass
ax40	5230	Sum	-4.84	0.328	5	0.3	9.33	-80	20	Pass
ax80	5210	Ant1	-11.03	0.079	2.5	0.15	-47.33	-80	20	Pass
ax80	5210	Ant2	-11.73	0.067	2.5	0.15	-55.33	-80	20	Pass
ax80	5210	Sum	-8.36	0.146	2.5	0.15	-2.67	-80	20	Pass



EIRP

Mode	Freq. (MHz)	Ant.	Power (dBm/MHz)	Power (mW/MHz)	Gain (dBi)	EIRP (dBm/MHz)	EIRP (mW/MHz)	Limit (mW/MHz)	Verdict
a	5180	Ant1	-0.64	0.863	5.12	4.48	2.805	10	Pass
a	5180	Ant2	-1.43	0.719	5.12	3.69	2.339	10	Pass
a	5180	Sum	1.99	1.582	/	7.11	5.144	10	Pass
a	5200	Ant1	-0.33	0.927	5.12	4.79	3.013	10	Pass
a	5200	Ant2	-1.08	0.78	5.12	4.04	2.535	10	Pass
a	5200	Sum	2.32	1.707	/	7.44	5.548	10	Pass
a	5240	Ant1	-1.63	0.687	5.12	3.49	2.234	10	Pass
a	5240	Ant2	-2.26	0.594	5.12	2.86	1.932	10	Pass
a	5240	Sum	1.08	1.281	/	6.2	4.166	10	Pass
n20	5180	Ant1	-0.62	0.867	5.12	4.5	2.818	10	Pass
n20	5180	Ant2	-1.68	0.679	5.12	3.44	2.208	10	Pass
n20	5180	Sum	1.89	1.546	/	7.01	5.026	10	Pass
n20	5200	Ant1	-0.84	0.824	5.12	4.28	2.679	10	Pass
n20	5200	Ant2	-1.59	0.693	5.12	3.53	2.254	10	Pass
n20	5200	Sum	1.81	1.517	/	6.93	4.933	10	Pass
n20	5240	Ant1	-1.8	0.661	5.12	3.32	2.148	10	Pass
n20	5240	Ant2	-2.65	0.543	5.12	2.47	1.766	10	Pass
n20	5240	Sum	0.81	1.204	/	5.93	3.914	10	Pass
n40	5190	Ant1	-2.24	0.597	5.12	2.88	1.941	5	Pass
n40	5190	Ant2	-4.15	0.385	5.12	0.97	1.25	5	Pass
n40	5190	Sum	-0.08	0.982	/	5.04	3.191	5	Pass
n40	5230	Ant1	-2.58	0.552	5.12	2.54	1.795	5	Pass
n40	5230	Ant2	-4.12	0.387	5.12	1	1.259	5	Pass
n40	5230	Sum	-0.27	0.939	/	4.85	3.054	5	Pass
ac20	5180	Ant1	-0.74	0.843	5.12	4.38	2.742	10	Pass
ac20	5180	Ant2	-1.59	0.693	5.12	3.53	2.254	10	Pass
ac20	5180	Sum	1.86	1.536	/	6.99	4.996	10	Pass
ac20	5200	Ant1	-1.03	0.789	5.12	4.09	2.564	10	Pass
ac20	5200	Ant2	-1.56	0.698	5.12	3.56	2.27	10	Pass
ac20	5200	Sum	1.72	1.487	/	6.84	4.834	10	Pass
ac20	5240	Ant1	-1.88	0.649	5.12	3.24	2.109	10	Pass
ac20	5240	Ant2	-2.75	0.531	5.12	2.37	1.726	10	Pass
ac20	5240	Sum	0.72	1.18	/	5.84	3.835	10	Pass
ac40	5190	Ant1	-2.31	0.587	5.12	2.81	1.91	5	Pass
ac40	5190	Ant2	-4.23	0.378	5.12	0.89	1.227	5	Pass
ac40	5190	Sum	-0.15	0.965	/	4.97	3.137	5	Pass
ac40	5230	Ant1	-2.96	0.506	5.12	2.16	1.644	5	Pass
ac40	5230	Ant2	-4.19	0.381	5.12	0.93	1.239	5	Pass
ac40	5230	Sum	-0.52	0.887	/	4.6	2.883	5	Pass
ac80	5210	Ant1	-5.99	0.252	5.12	-0.87	0.818	2.5	Pass



ac80	5210	Ant2	-6.98	0.2	5.12	-1.86	0.652	2.5	Pass
ac80	5210	Sum	-3.45	0.452	/	1.67	1.47	2.5	Pass
ax20	5180	Ant1	-4.49	0.356	5.12	0.63	1.156	10	Pass
ax20	5180	Ant2	-5.07	0.311	5.12	0.05	1.012	10	Pass
ax20	5180	Sum	-1.76	0.667	/	3.36	2.168	10	Pass
ax20	5200	Ant1	-4.97	0.318	5.12	0.15	1.035	10	Pass
ax20	5200	Ant2	-5.32	0.294	5.12	-0.2	0.955	10	Pass
ax20	5200	Sum	-2.13	0.612	/	2.99	1.99	10	Pass
ax20	5240	Ant1	-4.55	0.351	5.12	0.57	1.14	10	Pass
ax20	5240	Ant2	-5.62	0.274	5.12	-0.5	0.891	10	Pass
ax20	5240	Sum	-2.04	0.625	/	3.08	2.031	10	Pass
ax40	5190	Ant1	-7.07	0.196	5.12	-1.95	0.638	5	Pass
ax40	5190	Ant2	-8.57	0.139	5.12	-3.45	0.452	5	Pass
ax40	5190	Sum	-4.75	0.335	/	0.37	1.09	5	Pass
ax40	5230	Ant1	-7.07	0.196	5.12	-1.95	0.638	5	Pass
ax40	5230	Ant2	-8.78	0.132	5.12	-3.66	0.431	5	Pass
ax40	5230	Sum	-4.84	0.328	/	0.29	1.069	5	Pass
ax80	5210	Ant1	-11.03	0.079	5.12	-5.91	0.256	2.5	Pass
ax80	5210	Ant2	-11.73	0.067	5.12	-6.61	0.218	2.5	Pass
ax80	5210	Sum	-8.36	0.146	/	-3.24	0.474	2.5	Pass

**W53:**
Antenna Power

Mode	Freq. (MHz)	Ant.	Power (dBm/MHz)	Power (mW/MHz)	Limit (mW/MHz)	Declared Power (mW/MHz)	Tolerance (%)	Lower Limit (%)	Upper Limit (%)	Verdict
a	5260	Ant1	-4.24	0.377	10	0.70	-46.14	-80	20	Pass
a	5260	Ant2	-5.43	0.286	10	0.70	-59.14	-80	20	Pass
a	5260	Sum	-1.78	0.663	10	0.70	-5.29	-80	20	Pass
a	5300	Ant1	-4.37	0.366	10	0.70	-47.71	-80	20	Pass
a	5300	Ant2	-4.98	0.318	10	0.70	-54.57	-80	20	Pass
a	5300	Sum	-1.65	0.684	10	0.70	-2.29	-80	20	Pass
a	5320	Ant1	-4.28	0.373	10	0.70	-46.71	-80	20	Pass
a	5320	Ant2	-4.76	0.334	10	0.70	-52.29	-80	20	Pass
a	5320	Sum	-1.51	0.707	10	0.70	1.00	-80	20	Pass
n20	5260	Ant1	-4.81	0.33	10	0.70	-52.86	-80	20	Pass
n20	5260	Ant2	-4.95	0.32	10	0.70	-54.29	-80	20	Pass
n20	5260	Sum	-1.87	0.65	10	0.70	-7.14	-80	20	Pass
n20	5300	Ant1	-4.75	0.335	10	0.70	-52.14	-80	20	Pass
n20	5300	Ant2	-5.17	0.304	10	0.70	-56.57	-80	20	Pass
n20	5300	Sum	-1.94	0.639	10	0.70	-8.71	-80	20	Pass
n20	5320	Ant1	-4.52	0.353	10	0.70	-49.57	-80	20	Pass
n20	5320	Ant2	-5.03	0.314	10	0.70	-55.14	-80	20	Pass
n20	5320	Sum	-1.76	0.667	10	0.70	-4.71	-80	20	Pass
n40	5270	Ant1	-6.95	0.202	5	0.35	-42.29	-80	20	Pass
n40	5270	Ant2	-8.35	0.146	5	0.35	-58.29	-80	20	Pass
n40	5270	Sum	-4.58	0.348	5	0.35	-0.57	-80	20	Pass
n40	5310	Ant1	-7.46	0.179	5	0.35	-48.86	-80	20	Pass
n40	5310	Ant2	-7.66	0.171	5	0.35	-51.14	-80	20	Pass
n40	5310	Sum	-4.56	0.35	5	0.35	0.00	-80	20	Pass
ac20	5260	Ant1	-4.38	0.365	10	0.70	-47.86	-80	20	Pass
ac20	5260	Ant2	-5.08	0.31	10	0.70	-55.71	-80	20	Pass
ac20	5260	Sum	-1.71	0.675	10	0.70	-3.57	-80	20	Pass
ac20	5300	Ant1	-4.39	0.364	10	0.70	-48.00	-80	20	Pass
ac20	5300	Ant2	-4.96	0.319	10	0.70	-54.43	-80	20	Pass
ac20	5300	Sum	-1.66	0.683	10	0.70	-2.43	-80	20	Pass
ac20	5320	Ant1	-4.39	0.364	10	0.70	-48.00	-80	20	Pass
ac20	5320	Ant2	-4.95	0.32	10	0.70	-54.29	-80	20	Pass
ac20	5320	Sum	-1.65	0.684	10	0.70	-2.29	-80	20	Pass
ac40	5270	Ant1	-6.76	0.211	5	0.35	-39.71	-80	20	Pass
ac40	5270	Ant2	-7.96	0.16	5	0.35	-54.29	-80	20	Pass
ac40	5270	Sum	-4.31	0.371	5	0.35	6.00	-80	20	Pass
ac40	5310	Ant1	-6.65	0.216	5	0.35	-38.29	-80	20	Pass
ac40	5310	Ant2	-7.77	0.167	5	0.35	-52.29	-80	20	Pass
ac40	5310	Sum	-4.17	0.383	5	0.35	9.43	-80	20	Pass



ac80	5290	Ant1	-10.17	0.096	2.5	0.20	-52.00	-80	20	Pass
ac80	5290	Ant2	-10.78	0.084	2.5	0.20	-58.00	-80	20	Pass
ac80	5290	Sum	-7.45	0.18	2.5	0.20	-10.00	-80	20	Pass
ac160	5250	Ant1	-12.74	0.053	1.25	0.10	-47.00	-80	20	Pass
ac160	5250	Ant2	-13.47	0.045	1.25	0.10	-55.00	-80	20	Pass
ac160	5250	Sum	-10.09	0.098	1.25	0.10	-2.00	-80	20	Pass
ax20	5260	Ant1	-4.51	0.354	10	0.70	-49.43	-80	20	Pass
ax20	5260	Ant2	-5.6	0.275	10	0.70	-60.71	-80	20	Pass
ax20	5260	Sum	-2.01	0.629	10	0.70	-10.14	-80	20	Pass
ax20	5300	Ant1	-4.45	0.359	10	0.70	-48.71	-80	20	Pass
ax20	5300	Ant2	-4.94	0.321	10	0.70	-54.14	-80	20	Pass
ax20	5300	Sum	-1.67	0.68	10	0.70	-2.86	-80	20	Pass
ax20	5320	Ant1	-4.67	0.341	10	0.70	-51.29	-80	20	Pass
ax20	5320	Ant2	-5.65	0.272	10	0.70	-61.14	-80	20	Pass
ax20	5320	Sum	-2.13	0.613	10	0.70	-12.43	-80	20	Pass
ax40	5270	Ant1	-7.07	0.196	5	0.35	-44.00	-80	20	Pass
ax40	5270	Ant2	-8.31	0.148	5	0.35	-57.71	-80	20	Pass
ax40	5270	Sum	-4.63	0.344	5	0.35	-1.71	-80	20	Pass
ax40	5310	Ant1	-7.06	0.197	5	0.35	-43.71	-80	20	Pass
ax40	5310	Ant2	-8.48	0.142	5	0.35	-59.43	-80	20	Pass
ax40	5310	Sum	-4.7	0.339	5	0.35	-3.14	-80	20	Pass
ax80	5290	Ant1	-10.4	0.091	2.5	0.20	-54.50	-80	20	Pass
ax80	5290	Ant2	-11.49	0.071	2.5	0.20	-64.50	-80	20	Pass
ax80	5290	Sum	-7.9	0.162	2.5	0.20	-19.00	-80	20	Pass
ax160	5250	Ant1	-13.35	0.046	1.25	0.10	-54.00	-80	20	Pass
ax160	5250	Ant2	-14.2	0.038	1.25	0.10	-62.00	-80	20	Pass
ax160	5250	Sum	-10.76	0.084	1.25	0.10	-16.00	-80	20	Pass



EIRP

Mode	Freq. (MHz)	Ant.	Power (dBm/MHz)	Power (mW/MHz)	Gain (dBi)	EIRP (dBm/MHz)	EIRP (mW/MHz)	Limit (mW/MHz)	Verdict
a	5260	Ant1	-4.24	0.377	5.12	0.88	1.225	5	Pass
a	5260	Ant2	-5.43	0.286	5.12	-0.31	0.931	5	Pass
a	5260	Sum	-1.78	0.663	/	3.34	2.156	5	Pass
a	5300	Ant1	-4.37	0.366	5.12	0.75	1.189	5	Pass
a	5300	Ant2	-4.98	0.318	5.12	0.14	1.033	5	Pass
a	5300	Sum	-1.65	0.684	/	3.47	2.222	5	Pass
a	5320	Ant1	-4.28	0.373	5.12	0.84	1.213	5	Pass
a	5320	Ant2	-4.76	0.334	5.12	0.36	1.086	5	Pass
a	5320	Sum	-1.51	0.707	/	3.62	2.299	5	Pass
n20	5260	Ant1	-4.81	0.33	5.12	0.31	1.074	5	Pass
n20	5260	Ant2	-4.95	0.32	5.12	0.17	1.04	5	Pass
n20	5260	Sum	-1.87	0.65	/	3.25	2.114	5	Pass
n20	5300	Ant1	-4.75	0.335	5.12	0.37	1.089	5	Pass
n20	5300	Ant2	-5.17	0.304	5.12	-0.05	0.989	5	Pass
n20	5300	Sum	-1.94	0.639	/	3.18	2.078	5	Pass
n20	5320	Ant1	-4.52	0.353	5.12	0.60	1.148	5	Pass
n20	5320	Ant2	-5.03	0.314	5.12	0.09	1.021	5	Pass
n20	5320	Sum	-1.76	0.667	/	3.36	2.169	5	Pass
n40	5270	Ant1	-6.95	0.202	5.12	-1.83	0.656	2.5	Pass
n40	5270	Ant2	-8.35	0.146	5.12	-3.23	0.475	2.5	Pass
n40	5270	Sum	-4.58	0.348	/	0.53	1.131	2.5	Pass
n40	5310	Ant1	-7.46	0.179	5.12	-2.34	0.583	2.5	Pass
n40	5310	Ant2	-7.66	0.171	5.12	-2.54	0.557	2.5	Pass
n40	5310	Sum	-4.56	0.35	/	0.57	1.14	2.5	Pass
ac20	5260	Ant1	-4.38	0.365	5.12	0.74	1.186	5	Pass
ac20	5260	Ant2	-5.08	0.31	5.12	0.04	1.009	5	Pass
ac20	5260	Sum	-1.71	0.675	/	3.41	2.195	5	Pass
ac20	5300	Ant1	-4.39	0.364	5.12	0.73	1.183	5	Pass
ac20	5300	Ant2	-4.96	0.319	5.12	0.16	1.038	5	Pass
ac20	5300	Sum	-1.66	0.683	/	3.47	2.221	5	Pass
ac20	5320	Ant1	-4.39	0.364	5.12	0.73	1.183	5	Pass
ac20	5320	Ant2	-4.95	0.32	5.12	0.17	1.04	5	Pass
ac20	5320	Sum	-1.65	0.684	/	3.47	2.223	5	Pass
ac40	5270	Ant1	-6.76	0.211	5.12	-1.64	0.685	2.5	Pass
ac40	5270	Ant2	-7.96	0.16	5.12	-2.84	0.52	2.5	Pass
ac40	5270	Sum	-4.31	0.371	/	0.81	1.205	2.5	Pass
ac40	5310	Ant1	-6.65	0.216	5.12	-1.53	0.703	2.5	Pass
ac40	5310	Ant2	-7.77	0.167	5.12	-2.65	0.543	2.5	Pass
ac40	5310	Sum	-4.17	0.383	/	0.96	1.246	2.5	Pass
ac80	5290	Ant1	-10.17	0.096	5.12	-5.05	0.313	1.25	Pass
ac80	5290	Ant2	-10.78	0.084	5.12	-5.66	0.272	1.25	Pass



ac80	5290	Sum	-7.45	0.18	/	-2.33	0.585	1.25	Pass
ac160	5250	Ant1	-12.74	0.053	5.12	-7.62	0.173	0.625	Pass
ac160	5250	Ant2	-13.47	0.045	5.12	-8.35	0.146	0.625	Pass
ac160	5250	Sum	-10.09	0.098	/	-4.96	0.319	0.625	Pass
ax20	5260	Ant1	-4.51	0.354	5.12	0.61	1.151	5	Pass
ax20	5260	Ant2	-5.6	0.275	5.12	-0.48	0.895	5	Pass
ax20	5260	Sum	-2.01	0.629	/	3.11	2.046	5	Pass
ax20	5300	Ant1	-4.45	0.359	5.12	0.67	1.167	5	Pass
ax20	5300	Ant2	-4.94	0.321	5.12	0.18	1.042	5	Pass
ax20	5300	Sum	-1.67	0.68	/	3.44	2.209	5	Pass
ax20	5320	Ant1	-4.67	0.341	5.12	0.45	1.109	5	Pass
ax20	5320	Ant2	-5.65	0.272	5.12	-0.53	0.885	5	Pass
ax20	5320	Sum	-2.13	0.613	/	3	1.994	5	Pass
ax40	5270	Ant1	-7.07	0.196	5.12	-1.95	0.638	2.5	Pass
ax40	5270	Ant2	-8.31	0.148	5.12	-3.19	0.48	2.5	Pass
ax40	5270	Sum	-4.63	0.344	/	0.48	1.118	2.5	Pass
ax40	5310	Ant1	-7.06	0.197	5.12	-1.94	0.64	2.5	Pass
ax40	5310	Ant2	-8.48	0.142	5.12	-3.36	0.461	2.5	Pass
ax40	5310	Sum	-4.7	0.339	/	0.42	1.101	2.5	Pass
ax80	5290	Ant1	-10.4	0.091	5.12	-5.28	0.296	1.25	Pass
ax80	5290	Ant2	-11.49	0.071	5.12	-6.37	0.231	1.25	Pass
ax80	5290	Sum	-7.9	0.162	/	-2.78	0.527	1.25	Pass
ax160	5250	Ant1	-13.35	0.046	5.12	-8.23	0.15	0.625	Pass
ax160	5250	Ant2	-14.2	0.038	5.12	-9.08	0.124	0.625	Pass
ax160	5250	Sum	-10.76	0.084	/	-5.62	0.274	0.625	Pass

**W56:
Antenna Power**

Mode	Freq. (MHz)	Ant.	Power (dBm/MHz)	Power (mW/MHz)	Limit (mW/MHz)	Declared Power (mW/MHz)	Tolerance (%)	Lower Limit (%)	Upper Limit (%)	Verdict
a	5500	Ant1	1.14	1.3	10	1.8	-27.78	-50	50	Pass
a	5500	Ant2	0.28	1.067	10	1.8	-40.72	-50	50	Pass
a	5500	Sum	3.74	2.367	10	1.8	31.50	-50	50	Pass
a	5580	Ant1	0.8	1.202	10	1.8	-33.22	-50	50	Pass
a	5580	Ant2	0.66	1.164	10	1.8	-35.33	-50	50	Pass
a	5580	Sum	3.74	2.366	10	1.8	31.44	-50	50	Pass
a	5720	Ant1	0.91	1.233	10	1.8	-31.50	-50	50	Pass
a	5720	Ant2	-0.15	0.966	10	1.8	-46.33	-50	50	Pass
a	5720	Sum	3.42	2.199	10	1.8	22.17	-50	50	Pass
n20	5500	Ant1	0.98	1.253	10	1.8	-30.39	-50	50	Pass
n20	5500	Ant2	-0.05	0.989	10	1.8	-45.06	-50	50	Pass
n20	5500	Sum	3.51	2.242	10	1.8	24.56	-50	50	Pass
n20	5580	Ant1	0.4	1.096	10	1.8	-39.11	-50	50	Pass
n20	5580	Ant2	0.14	1.033	10	1.8	-42.61	-50	50	Pass
n20	5580	Sum	3.28	2.129	10	1.8	18.28	-50	50	Pass
n20	5720	Ant1	0.46	1.112	10	1.8	-38.22	-50	50	Pass
n20	5720	Ant2	-0.36	0.92	10	1.8	-48.89	-50	50	Pass
n20	5720	Sum	3.08	2.032	10	1.8	12.89	-50	50	Pass
n40	5510	Ant1	-2.22	0.6	5	0.8	-25.00	-50	50	Pass
n40	5510	Ant2	-3.15	0.484	5	0.8	-39.50	-50	50	Pass
n40	5510	Sum	0.35	1.084	5	0.8	35.50	-50	50	Pass
n40	5590	Ant1	-2.6	0.55	5	0.8	-31.25	-50	50	Pass
n40	5590	Ant2	-2.73	0.533	5	0.8	-33.38	-50	50	Pass
n40	5590	Sum	0.35	1.083	5	0.8	35.38	-50	50	Pass
n40	5710	Ant1	-1.71	0.675	5	0.8	-15.63	-50	50	Pass
n40	5710	Ant2	-3.39	0.458	5	0.8	-42.75	-50	50	Pass
n40	5710	Sum	0.54	1.133	5	0.8	41.63	-50	50	Pass
ac20	5500	Ant1	0.29	1.069	10	1.8	-40.61	-50	50	Pass
ac20	5500	Ant2	0.21	1.05	10	1.8	-41.67	-50	50	Pass
ac20	5500	Sum	3.26	2.119	10	1.8	17.72	-50	50	Pass
ac20	5580	Ant1	0.57	1.14	10	1.8	-36.67	-50	50	Pass
ac20	5580	Ant2	0.28	1.067	10	1.8	-40.72	-50	50	Pass
ac20	5580	Sum	3.44	2.207	10	1.8	22.61	-50	50	Pass
ac20	5720	Ant1	0.67	1.167	10	1.8	-35.17	-50	50	Pass
ac20	5720	Ant2	-0.2	0.955	10	1.8	-46.94	-50	50	Pass
ac20	5720	Sum	3.27	2.122	10	1.8	17.89	-50	50	Pass
ac40	5510	Ant1	-2.15	0.61	5	0.8	-23.75	-50	50	Pass
ac40	5510	Ant2	-3.26	0.472	5	0.8	-41.00	-50	50	Pass
ac40	5510	Sum	0.34	1.082	5	0.8	35.25	-50	50	Pass



ac40	5590	Ant1	-2.23	0.598	5	0.8	-25.25	-50	50	Pass
ac40	5590	Ant2	-2.93	0.509	5	0.8	-36.38	-50	50	Pass
ac40	5590	Sum	0.44	1.107	5	0.8	38.38	-50	50	Pass
ac40	5710	Ant1	-1.36	0.731	5	0.8	-8.63	-50	50	Pass
ac40	5710	Ant2	-3.43	0.454	5	0.8	-43.25	-50	50	Pass
ac40	5710	Sum	0.74	1.185	5	0.8	48.13	-50	50	Pass
ac80	5530	Ant1	-5.22	0.301	2.5	0.4	-24.75	-50	50	Pass
ac80	5530	Ant2	-6.07	0.247	2.5	0.4	-38.25	-50	50	Pass
ac80	5530	Sum	-2.61	0.548	2.5	0.4	37.00	-50	50	Pass
ac80	5690	Ant1	-5.57	0.277	2.5	0.4	-30.75	-50	50	Pass
ac80	5690	Ant2	-6.49	0.224	2.5	0.4	-44.00	-50	50	Pass
ac80	5690	Sum	-3	0.501	2.5	0.4	25.25	-50	50	Pass
ac160	5570	Ant1	-9.02	0.125	1.25	0.2	-37.50	-50	50	Pass
ac160	5570	Ant2	-9.43	0.114	1.25	0.2	-43.00	-50	50	Pass
ac160	5570	Sum	-6.22	0.239	1.25	0.2	19.50	-50	50	Pass
ax20	5500	Ant1	0.5	1.122	10	1.5	-25.20	-50	50	Pass
ax20	5500	Ant2	-0.56	0.879	10	1.5	-41.40	-50	50	Pass
ax20	5500	Sum	3.01	2.001	10	1.5	33.40	-50	50	Pass
ax20	5580	Ant1	0.26	1.062	10	1.5	-29.20	-50	50	Pass
ax20	5580	Ant2	-0.16	0.964	10	1.5	-35.73	-50	50	Pass
ax20	5580	Sum	3.07	2.026	10	1.5	35.07	-50	50	Pass
ax20	5720	Ant1	0.26	1.062	10	1.5	-29.20	-50	50	Pass
ax20	5720	Ant2	-0.91	0.811	10	1.5	-45.93	-50	50	Pass
ax20	5720	Sum	2.73	1.873	10	1.5	24.87	-50	50	Pass
ax40	5510	Ant1	-2.57	0.553	5	0.7	-21.00	-50	50	Pass
ax40	5510	Ant2	-3.59	0.438	5	0.7	-37.43	-50	50	Pass
ax40	5510	Sum	-0.04	0.991	5	0.7	41.57	-50	50	Pass
ax40	5590	Ant1	-2.96	0.506	5	0.7	-27.71	-50	50	Pass
ax40	5590	Ant2	-3.42	0.455	5	0.7	-35.00	-50	50	Pass
ax40	5590	Sum	-0.17	0.961	5	0.7	37.29	-50	50	Pass
ax40	5710	Ant1	-2.79	0.526	5	0.7	-24.86	-50	50	Pass
ax40	5710	Ant2	-3.99	0.399	5	0.7	-43.00	-50	50	Pass
ax40	5710	Sum	-0.34	0.925	5	0.7	32.14	-50	50	Pass
ax80	5530	Ant1	-6.08	0.247	2.5	0.35	-29.43	-50	50	Pass
ax80	5530	Ant2	-6.72	0.213	2.5	0.35	-39.14	-50	50	Pass
ax80	5530	Sum	-3.37	0.46	2.5	0.35	31.43	-50	50	Pass
ax80	5690	Ant1	-7	0.2	2.5	0.35	-42.86	-50	50	Pass
ax80	5690	Ant2	-7.54	0.176	2.5	0.35	-49.71	-50	50	Pass
ax80	5690	Sum	-4.25	0.376	2.5	0.35	7.43	-50	50	Pass
ax160	5570	Ant1	-9.19	0.121	1.25	0.2	-39.50	-50	50	Pass
ax160	5570	Ant2	-9.73	0.106	1.25	0.2	-47.00	-50	50	Pass
ax160	5570	Sum	-6.44	0.227	1.25	0.2	13.50	-50	50	Pass



EIRP

Mode	Freq. (MHz)	Ant.	Power (dBm/MHz)	Power (mW/MHz)	Gain (dBi)	EIRP (dBm/MHz)	EIRP (mW/MHz)	Limit (mW/MHz)	Verdict
a	5500	Ant1	1.14	1.3	4.28	5.42	3.483	25	Pass
a	5500	Ant2	0.28	1.067	4.28	4.56	2.858	25	Pass
a	5500	Sum	3.74	2.367	/	8.02	6.341	25	Pass
a	5580	Ant1	0.8	1.202	4.28	5.08	3.221	25	Pass
a	5580	Ant2	0.66	1.164	4.28	4.94	3.119	25	Pass
a	5580	Sum	3.74	2.366	/	8.02	6.34	25	Pass
a	5720	Ant1	0.91	1.233	4.28	5.19	3.304	25	Pass
a	5720	Ant2	-0.15	0.966	4.28	4.13	2.588	25	Pass
a	5720	Sum	3.42	2.199	/	7.7	5.892	25	Pass
n20	5500	Ant1	0.98	1.253	4.28	5.26	3.357	25	Pass
n20	5500	Ant2	-0.05	0.989	4.28	4.23	2.649	25	Pass
n20	5500	Sum	3.51	2.242	/	7.79	6.006	25	Pass
n20	5580	Ant1	0.4	1.096	4.28	4.68	2.938	25	Pass
n20	5580	Ant2	0.14	1.033	4.28	4.42	2.767	25	Pass
n20	5580	Sum	3.28	2.129	/	7.56	5.705	25	Pass
n20	5720	Ant1	0.46	1.112	4.28	4.74	2.979	25	Pass
n20	5720	Ant2	-0.36	0.92	4.28	3.92	2.466	25	Pass
n20	5720	Sum	3.08	2.032	/	7.36	5.445	25	Pass
n40	5510	Ant1	-2.22	0.6	4.28	2.06	1.607	12.5	Pass
n40	5510	Ant2	-3.15	0.484	4.28	1.13	1.297	12.5	Pass
n40	5510	Sum	0.35	1.084	/	4.63	2.904	12.5	Pass
n40	5590	Ant1	-2.6	0.55	4.28	1.68	1.472	12.5	Pass
n40	5590	Ant2	-2.73	0.533	4.28	1.55	1.429	12.5	Pass
n40	5590	Sum	0.35	1.083	/	4.63	2.901	12.5	Pass
n40	5710	Ant1	-1.71	0.675	4.28	2.57	1.807	12.5	Pass
n40	5710	Ant2	-3.39	0.458	4.28	0.89	1.227	12.5	Pass
n40	5710	Sum	0.54	1.133	/	4.82	3.034	12.5	Pass
ac20	5500	Ant1	0.29	1.069	4.28	4.57	2.864	25	Pass
ac20	5500	Ant2	0.21	1.05	4.28	4.49	2.812	25	Pass
ac20	5500	Sum	3.26	2.119	/	7.54	5.676	25	Pass
ac20	5580	Ant1	0.57	1.14	4.28	4.85	3.055	25	Pass
ac20	5580	Ant2	0.28	1.067	4.28	4.56	2.858	25	Pass
ac20	5580	Sum	3.44	2.207	/	7.72	5.913	25	Pass
ac20	5720	Ant1	0.67	1.167	4.28	4.95	3.126	25	Pass
ac20	5720	Ant2	-0.2	0.955	4.28	4.08	2.559	25	Pass
ac20	5720	Sum	3.27	2.122	/	7.55	5.685	25	Pass
ac40	5510	Ant1	-2.15	0.61	4.28	2.13	1.633	12.5	Pass
ac40	5510	Ant2	-3.26	0.472	4.28	1.02	1.265	12.5	Pass
ac40	5510	Sum	0.34	1.082	/	4.62	2.898	12.5	Pass
ac40	5590	Ant1	-2.23	0.598	4.28	2.05	1.603	12.5	Pass
ac40	5590	Ant2	-2.93	0.509	4.28	1.35	1.365	12.5	Pass
ac40	5590	Sum	0.44	1.107	/	4.72	2.968	12.5	Pass
ac40	5710	Ant1	-1.36	0.731	4.28	2.92	1.959	12.5	Pass
ac40	5710	Ant2	-3.43	0.454	4.28	0.85	1.216	12.5	Pass



ac40	5710	Sum	0.74	1.185	/	5.02	3.175	12.5	Pass
ac80	5530	Ant1	-5.22	0.301	4.28	-0.94	0.805	6.25	Pass
ac80	5530	Ant2	-6.07	0.247	4.28	-1.79	0.662	6.25	Pass
ac80	5530	Sum	-2.61	0.548	/	1.66	1.467	6.25	Pass
ac80	5690	Ant1	-5.57	0.277	4.28	-1.29	0.743	6.25	Pass
ac80	5690	Ant2	-6.49	0.224	4.28	-2.21	0.601	6.25	Pass
ac80	5690	Sum	-3	0.501	/	1.28	1.344	6.25	Pass
ac160	5570	Ant1	-9.02	0.125	4.28	-4.74	0.336	3.125	Pass
ac160	5570	Ant2	-9.43	0.114	4.28	-5.15	0.305	3.125	Pass
ac160	5570	Sum	-6.22	0.239	/	-1.93	0.641	3.125	Pass
ax20	5500	Ant1	0.5	1.122	4.28	4.78	3.006	25	Pass
ax20	5500	Ant2	-0.56	0.879	4.28	3.72	2.355	25	Pass
ax20	5500	Sum	3.01	2.001	/	7.29	5.361	25	Pass
ax20	5580	Ant1	0.26	1.062	4.28	4.54	2.844	25	Pass
ax20	5580	Ant2	-0.16	0.964	4.28	4.12	2.582	25	Pass
ax20	5580	Sum	3.07	2.026	/	7.34	5.426	25	Pass
ax20	5720	Ant1	0.26	1.062	4.28	4.54	2.844	25	Pass
ax20	5720	Ant2	-0.91	0.811	4.28	3.37	2.173	25	Pass
ax20	5720	Sum	2.73	1.873	/	7	5.017	25	Pass
ax40	5510	Ant1	-2.57	0.553	4.28	1.71	1.483	12.5	Pass
ax40	5510	Ant2	-3.59	0.438	4.28	0.69	1.172	12.5	Pass
ax40	5510	Sum	-0.04	0.991	/	4.24	2.655	12.5	Pass
ax40	5590	Ant1	-2.96	0.506	4.28	1.32	1.355	12.5	Pass
ax40	5590	Ant2	-3.42	0.455	4.28	0.86	1.219	12.5	Pass
ax40	5590	Sum	-0.17	0.961	/	4.11	2.574	12.5	Pass
ax40	5710	Ant1	-2.79	0.526	4.28	1.49	1.409	12.5	Pass
ax40	5710	Ant2	-3.99	0.399	4.28	0.29	1.069	12.5	Pass
ax40	5710	Sum	-0.34	0.925	/	3.94	2.478	12.5	Pass
ax80	5530	Ant1	-6.08	0.247	4.28	-1.8	0.661	6.25	Pass
ax80	5530	Ant2	-6.72	0.213	4.28	-2.44	0.57	6.25	Pass
ax80	5530	Sum	-3.37	0.46	/	0.9	1.231	6.25	Pass
ax80	5690	Ant1	-7	0.2	4.28	-2.72	0.535	6.25	Pass
ax80	5690	Ant2	-7.54	0.176	4.28	-3.26	0.472	6.25	Pass
ax80	5690	Sum	-4.25	0.376	/	0.03	1.007	6.25	Pass
ax160	5570	Ant1	-9.19	0.121	4.28	-4.91	0.323	3.125	Pass
ax160	5570	Ant2	-9.73	0.106	4.28	-5.45	0.285	3.125	Pass
ax160	5570	Sum	-6.44	0.227	/	-2.16	0.608	3.125	Pass

Note:

1. Declared Power by manufacturer
2. Antenna output power tolerance (%) = (Antenna output power - declared power)/declared power*100%
3. EIRP (mW/MHz)= $10^{((\text{Output Power (dBm/MHz)} + \text{Antenna Gain})/10)}$

9. Adjacent Channel Emitted Power


9.1 Limit

DSSS	OFDM			
18MHz	20MHz	40MHz	80MHz	160MHz
$F_c \pm 20\text{MHz}$ $\pm 10\text{MHz BW: -25dBc}$	$F_c \pm 20\text{MHz}$ $\pm 10\text{MHz BW: -25dBc}$	$F_c \pm 40\text{MHz}$ $\pm 20\text{MHz BW: -25dBc}$	$F_c \pm 80\text{MHz}$ $\pm 40\text{MHz BW: -25dBc}$	
$F_c \pm 40\text{MHz}$ $\pm 10\text{MHz BW: -40dBc}$	$F_c \pm 40\text{MHz}$ $\pm 10\text{MHz BW: -40dBc}$	$F_c \pm 80\text{MHz}$ $\pm 20\text{MHz BW: -40dBc}$	—	

9.2 Measurement Procedure

- Set EUT work in test mode as described in clause 2.4.
- Connected the EUT's antenna port to the Spectrum Analyzer by suitable attenuator, set the Spectrum Analyzer as below:
RBW/VBW= 300kHz / 300kHz.
Detector: Peak.
Trace Mode: Max Hold.

9.3 Test Setup

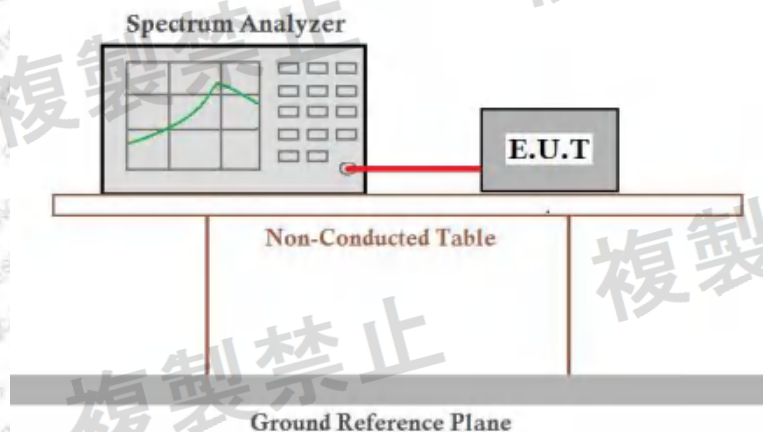

9.4 Test Data

Temperature	25 °C	Humidity	55 %
ATM Pressure	101.1kPa	Antenna Gain	See page 5
Test by	Fan Yang	Test result	PASS

Please refer to following table.

**Normal Voltage
W52:**

Mode	Frequency (MHz)	Antenna	Offset (MHz)	Value (dBc)	Limit (dBc)	Verdict
a	5180	Ant1	-20	-30.15	-25	Pass
a	5180	Ant1	-40	-47.64	-40	Pass
a	5180	Ant1	20	-31.1	-25	Pass
a	5180	Ant1	40	-46.63	-40	Pass
a	5180	Ant2	-20	-27.77	-25	Pass
a	5180	Ant2	-40	-46.01	-40	Pass
a	5180	Ant2	20	-28.02	-25	Pass
a	5180	Ant2	40	-45.37	-40	Pass
a	5200	Ant1	-20	-28.95	-25	Pass
a	5200	Ant1	-40	-46.19	-40	Pass
a	5200	Ant1	20	-26.96	-25	Pass
a	5200	Ant1	40	-45.24	-40	Pass
a	5200	Ant2	-20	-28.1	-25	Pass
a	5200	Ant2	-40	-46.45	-40	Pass
a	5200	Ant2	20	-28.93	-25	Pass
a	5200	Ant2	40	-45.79	-40	Pass
a	5240	Ant1	-20	-27.68	-25	Pass
a	5240	Ant1	-40	-45.84	-40	Pass
a	5240	Ant1	20	-26.22	-25	Pass
a	5240	Ant1	40	-44.76	-40	Pass
a	5240	Ant2	-20	-26.19	-25	Pass
a	5240	Ant2	-40	-43.94	-40	Pass
a	5240	Ant2	20	-27.7	-25	Pass
a	5240	Ant2	40	-43.38	-40	Pass
n20	5180	Ant1	-20	-33.14	-25	Pass
n20	5180	Ant1	-40	-52.34	-40	Pass
n20	5180	Ant1	20	-30.75	-25	Pass
n20	5180	Ant1	40	-51.25	-40	Pass
n20	5180	Ant2	-20	-31.56	-25	Pass
n20	5180	Ant2	-40	-51.06	-40	Pass
n20	5180	Ant2	20	-29.73	-25	Pass
n20	5180	Ant2	40	-50.25	-40	Pass
n20	5200	Ant1	-20	-29.05	-25	Pass
n20	5200	Ant1	-40	-50.16	-40	Pass
n20	5200	Ant1	20	-26.56	-25	Pass
n20	5200	Ant1	40	-49.41	-40	Pass
n20	5200	Ant2	-20	-28.67	-25	Pass
n20	5200	Ant2	-40	-51.66	-40	Pass
n20	5200	Ant2	20	-28.87	-25	Pass
n20	5200	Ant2	40	-50.7	-40	Pass



n20	5240	Ant1	-20	-27.72	-25	Pass
n20	5240	Ant1	-40	-50.18	-40	Pass
n20	5240	Ant1	20	-27.76	-25	Pass
n20	5240	Ant1	40	-49.14	-40	Pass
n20	5240	Ant2	-20	-30.12	-25	Pass
n20	5240	Ant2	-40	-50.18	-40	Pass
n20	5240	Ant2	20	-29.46	-25	Pass
n20	5240	Ant2	40	-49.62	-40	Pass
n40	5190	Ant1	-40	-31.96	-25	Pass
n40	5190	Ant1	-80	-51.3	-40	Pass
n40	5190	Ant1	40	-35.34	-25	Pass
n40	5190	Ant1	80	-50.55	-40	Pass
n40	5190	Ant2	-40	-33.13	-25	Pass
n40	5190	Ant2	-80	-48.63	-40	Pass
n40	5190	Ant2	40	-31.16	-25	Pass
n40	5190	Ant2	80	-46.8	-40	Pass
n40	5230	Ant1	-40	-35.53	-25	Pass
n40	5230	Ant1	-80	-51.51	-40	Pass
n40	5230	Ant1	40	-28.96	-25	Pass
n40	5230	Ant1	80	-49.2	-40	Pass
n40	5230	Ant2	-40	-32.67	-25	Pass
n40	5230	Ant2	-80	-49.67	-40	Pass
n40	5230	Ant2	40	-30.53	-25	Pass
n40	5230	Ant2	80	-47.77	-40	Pass
ac20	5180	Ant1	-20	-29.89	-25	Pass
ac20	5180	Ant1	-40	-51.01	-40	Pass
ac20	5180	Ant1	20	-29.4	-25	Pass
ac20	5180	Ant1	40	-49.58	-40	Pass
ac20	5180	Ant2	-20	-30.47	-25	Pass
ac20	5180	Ant2	-40	-50.73	-40	Pass
ac20	5180	Ant2	20	-28.77	-25	Pass
ac20	5180	Ant2	40	-49.88	-40	Pass
ac20	5200	Ant1	-20	-30.27	-25	Pass
ac20	5200	Ant1	-40	-49.97	-40	Pass
ac20	5200	Ant1	20	-27.85	-25	Pass
ac20	5200	Ant1	40	-49.52	-40	Pass
ac20	5200	Ant2	-20	-28.63	-25	Pass
ac20	5200	Ant2	-40	-50.99	-40	Pass
ac20	5200	Ant2	20	-28.68	-25	Pass
ac20	5200	Ant2	40	-50.11	-40	Pass
ac20	5240	Ant1	-20	-30.13	-25	Pass
ac20	5240	Ant1	-40	-50.4	-40	Pass
ac20	5240	Ant1	20	-29.03	-25	Pass




ac20	5240	Ant1	40	-49.36	-40	Pass
ac20	5240	Ant2	-20	-28.97	-25	Pass
ac20	5240	Ant2	-40	-49.27	-40	Pass
ac20	5240	Ant2	20	-30	-25	Pass
ac20	5240	Ant2	40	-48.71	-40	Pass
ac40	5190	Ant1	-40	-31.76	-25	Pass
ac40	5190	Ant1	-80	-49.47	-40	Pass
ac40	5190	Ant1	40	-33.54	-25	Pass
ac40	5190	Ant1	80	-48.43	-40	Pass
ac40	5190	Ant2	-40	-32.99	-25	Pass
ac40	5190	Ant2	-80	-48.93	-40	Pass
ac40	5190	Ant2	40	-31.04	-25	Pass
ac40	5190	Ant2	80	-47.01	-40	Pass
ac40	5230	Ant1	-40	-35.95	-25	Pass
ac40	5230	Ant1	-80	-51.27	-40	Pass
ac40	5230	Ant1	40	-31.16	-25	Pass
ac40	5230	Ant1	80	-48.95	-40	Pass
ac40	5230	Ant2	-40	-33	-25	Pass
ac40	5230	Ant2	-80	-49.85	-40	Pass
ac40	5230	Ant2	40	-31.93	-25	Pass
ac40	5230	Ant2	80	-47.9	-40	Pass
ac80	5210	Ant1	-80	-33.42	-25	Pass
ac80	5210	Ant1	-160	-48.09	-40	Pass
ac80	5210	Ant1	80	-31.43	-25	Pass
ac80	5210	Ant1	160	-46.2	-40	Pass
ac80	5210	Ant2	-80	-35.08	-25	Pass
ac80	5210	Ant2	-160	-47	-40	Pass
ac80	5210	Ant2	80	-33.5	-25	Pass
ac80	5210	Ant2	160	-44.97	-40	Pass
ax20	5180	Ant1	-20	-29.57	-25	Pass
ax20	5180	Ant1	-40	-47.82	-40	Pass
ax20	5180	Ant1	20	-29.98	-25	Pass
ax20	5180	Ant1	40	-46.82	-40	Pass
ax20	5180	Ant2	-20	-29.51	-25	Pass
ax20	5180	Ant2	-40	-47.15	-40	Pass
ax20	5180	Ant2	20	-27.74	-25	Pass
ax20	5180	Ant2	40	-46.12	-40	Pass
ax20	5200	Ant1	-20	-29.19	-25	Pass
ax20	5200	Ant1	-40	-48.16	-40	Pass
ax20	5200	Ant1	20	-29.27	-25	Pass
ax20	5200	Ant1	40	-47.24	-40	Pass
ax20	5200	Ant2	-20	-30.9	-25	Pass
ax20	5200	Ant2	-40	-47.43	-40	Pass



ax20	5200	Ant2	20	-29.14	-25	Pass
ax20	5200	Ant2	40	-46.49	-40	Pass
ax20	5240	Ant1	-20	-28.02	-25	Pass
ax20	5240	Ant1	-40	-46.55	-40	Pass
ax20	5240	Ant1	20	-27.87	-25	Pass
ax20	5240	Ant1	40	-45.51	-40	Pass
ax20	5240	Ant2	-20	-31.56	-25	Pass
ax20	5240	Ant2	-40	-46.81	-40	Pass
ax20	5240	Ant2	20	-29.75	-25	Pass
ax20	5240	Ant2	40	-46.19	-40	Pass
ax40	5190	Ant1	-40	-32.82	-25	Pass
ax40	5190	Ant1	-80	-44.69	-40	Pass
ax40	5190	Ant1	40	-31.73	-25	Pass
ax40	5190	Ant1	80	-43.69	-40	Pass
ax40	5190	Ant2	-40	-31.81	-25	Pass
ax40	5190	Ant2	-80	-44.41	-40	Pass
ax40	5190	Ant2	40	-30	-25	Pass
ax40	5190	Ant2	80	-42.82	-40	Pass
ax40	5230	Ant1	-40	-35.53	-25	Pass
ax40	5230	Ant1	-80	-46.36	-40	Pass
ax40	5230	Ant1	40	-31.24	-25	Pass
ax40	5230	Ant1	80	-44.53	-40	Pass
ax40	5230	Ant2	-40	-30.28	-25	Pass
ax40	5230	Ant2	-80	-44.95	-40	Pass
ax40	5230	Ant2	40	-32.13	-25	Pass
ax40	5230	Ant2	80	-43.67	-40	Pass
ax80	5210	Ant1	-80	-32.24	-25	Pass
ax80	5210	Ant1	-160	-42.71	-40	Pass
ax80	5210	Ant1	80	-32.09	-25	Pass
ax80	5210	Ant1	160	-40.77	-40	Pass
ax80	5210	Ant2	-80	-32.64	-25	Pass
ax80	5210	Ant2	-160	-43.76	-40	Pass
ax80	5210	Ant2	80	-33.34	-25	Pass
ax80	5210	Ant2	160	-41.75	-40	Pass




ACEP NVNT a 5180MHz Ant1

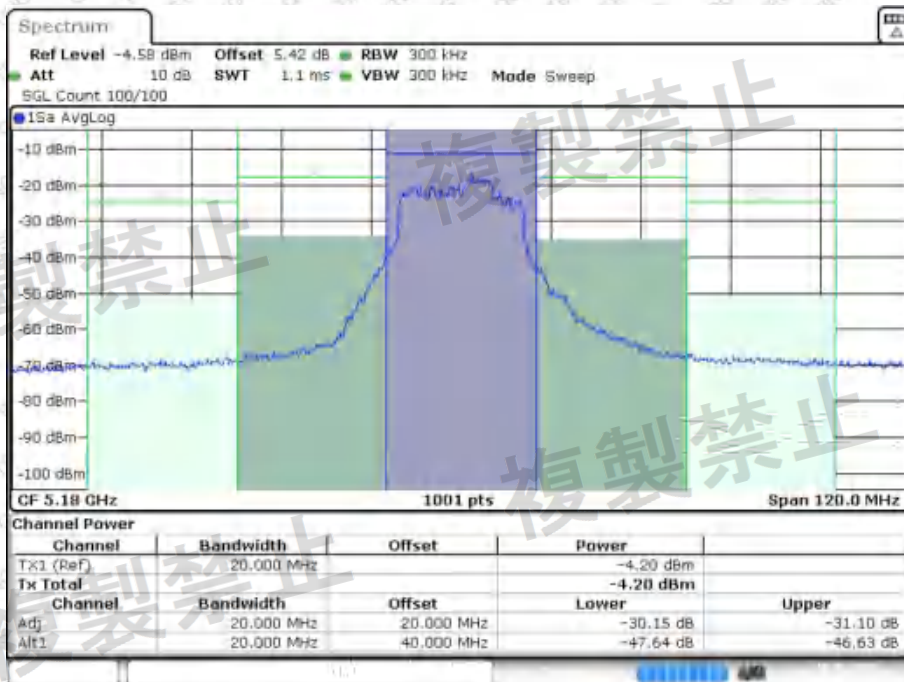

Date: 18.MAY.2025 17:55:05


ACEP NVNT a 5180MHz Ant2

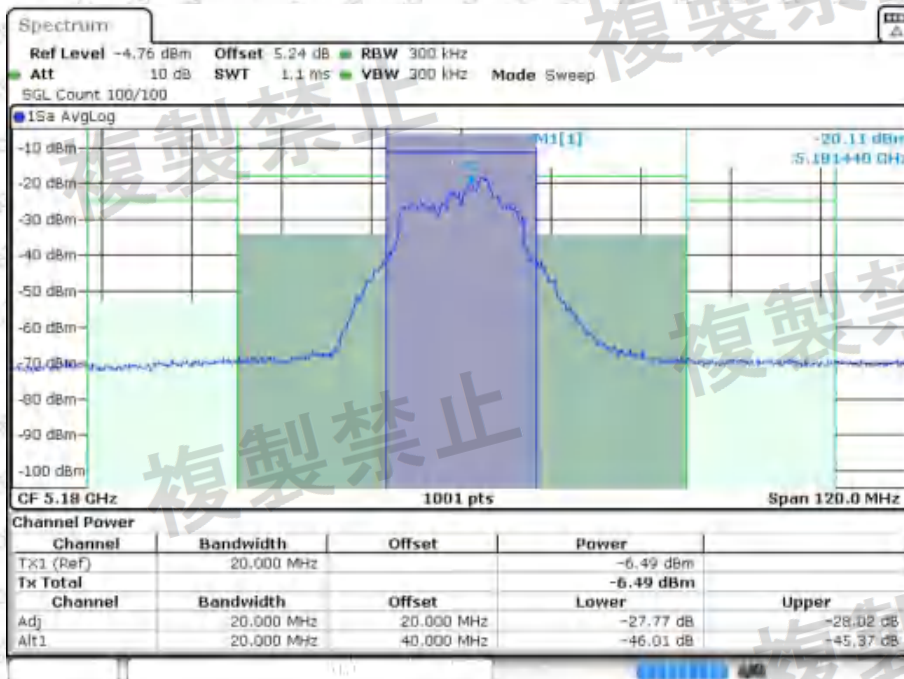

Date: 18.MAY.2025 17:55:07




ACEP NVNT a 5200MHz Ant1

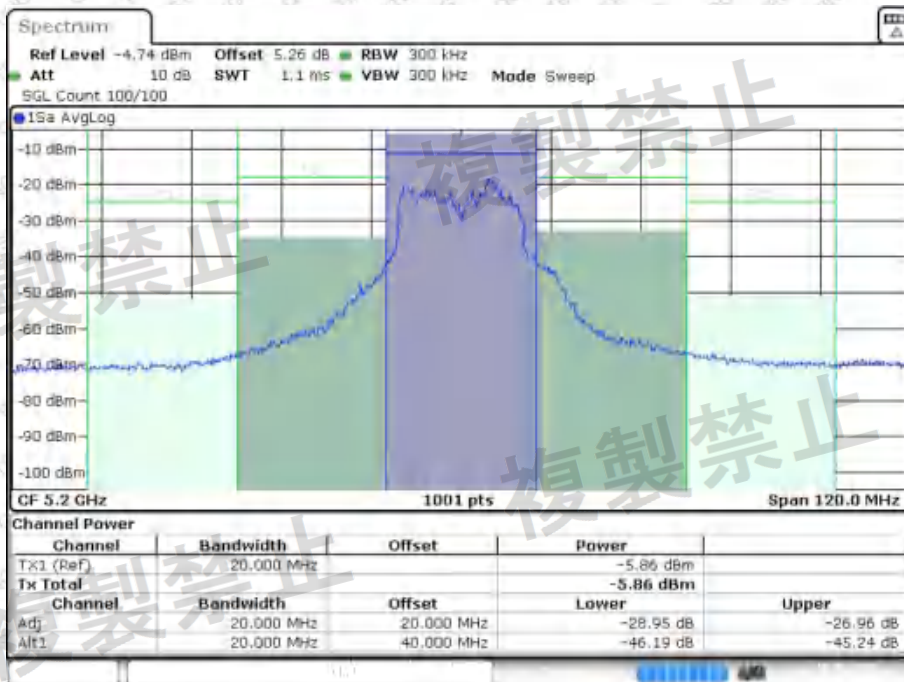

Date: 18.MAY.2025 17:57:49


ACEP NVNT a 5200MHz Ant2

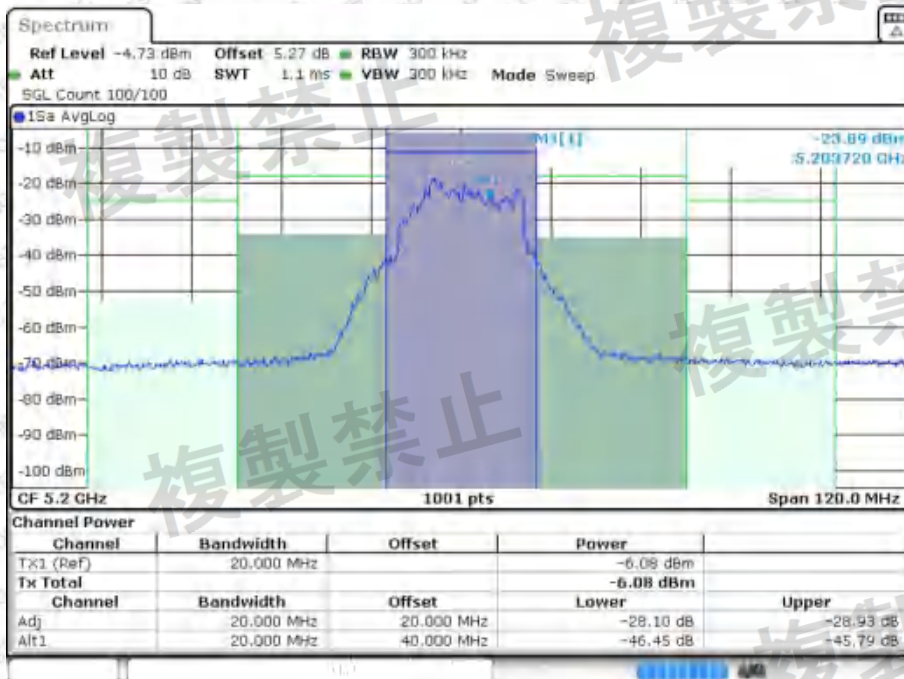

Date: 18.MAY.2025 17:57:51




ACEP NVNT a 5240MHz Ant1

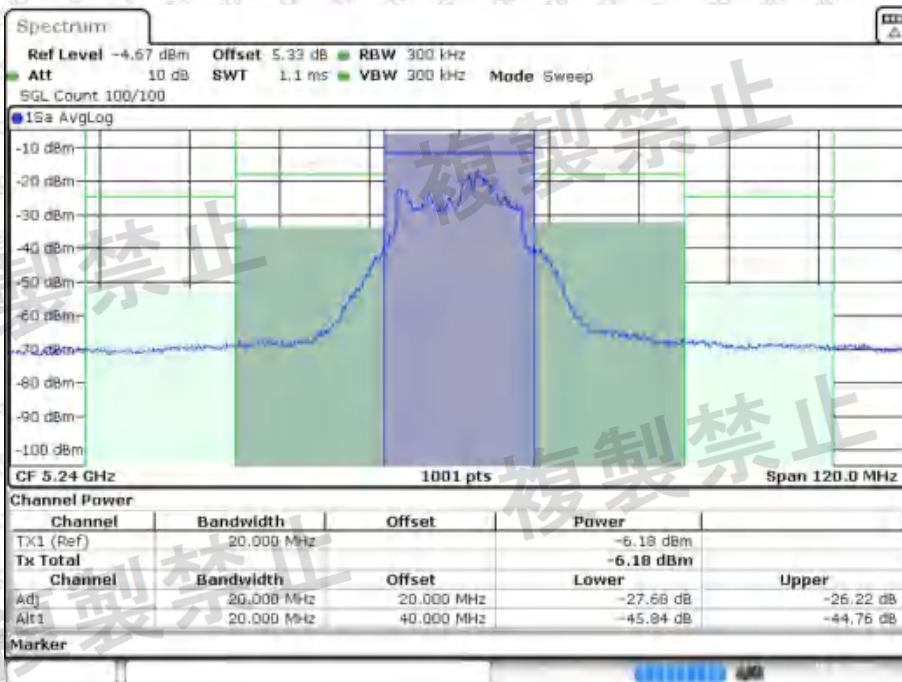

Date: 18.MAY.2025 17:58:59


ACEP NVNT a 5240MHz Ant2

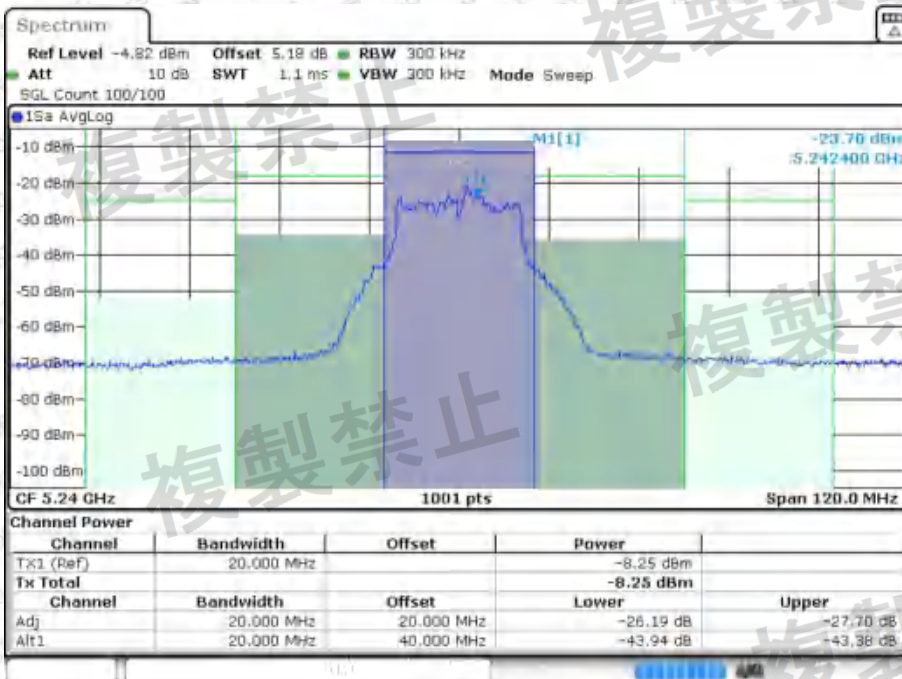


Date: 18.MAY.2025 17:59:01



ACEP NVNT n20 5180MHz Ant1

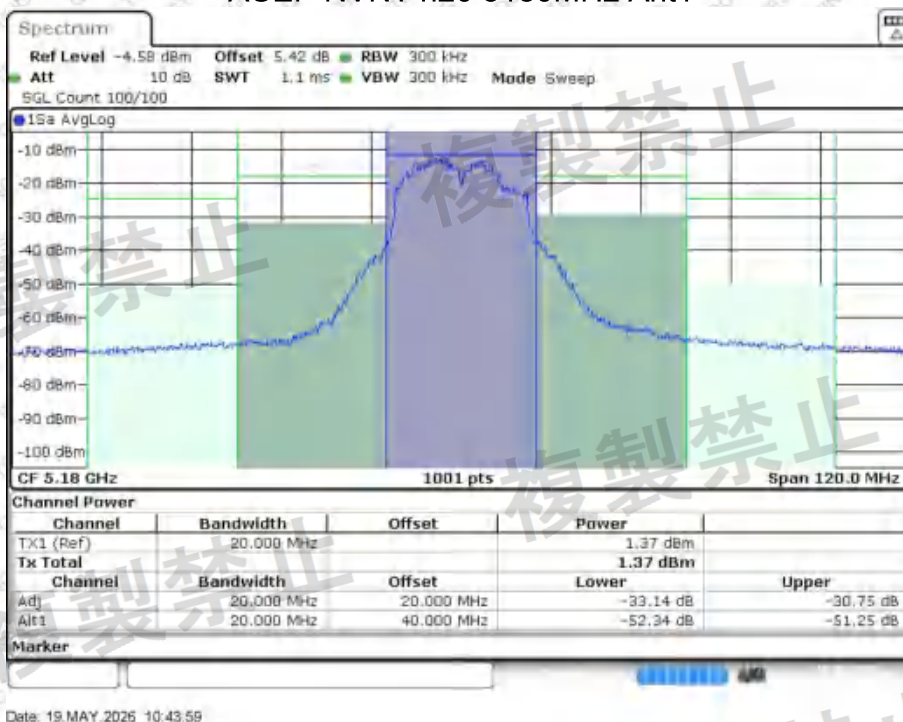


ACEP NVNT n20 5180MHz Ant2

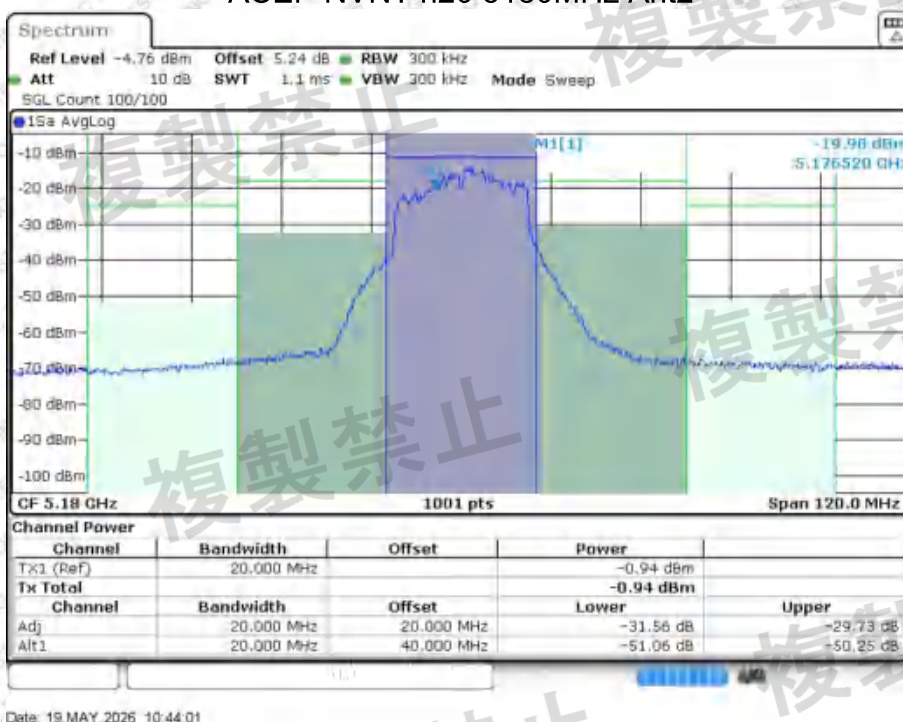




ACEP NVNT n20 5200MHz Ant1

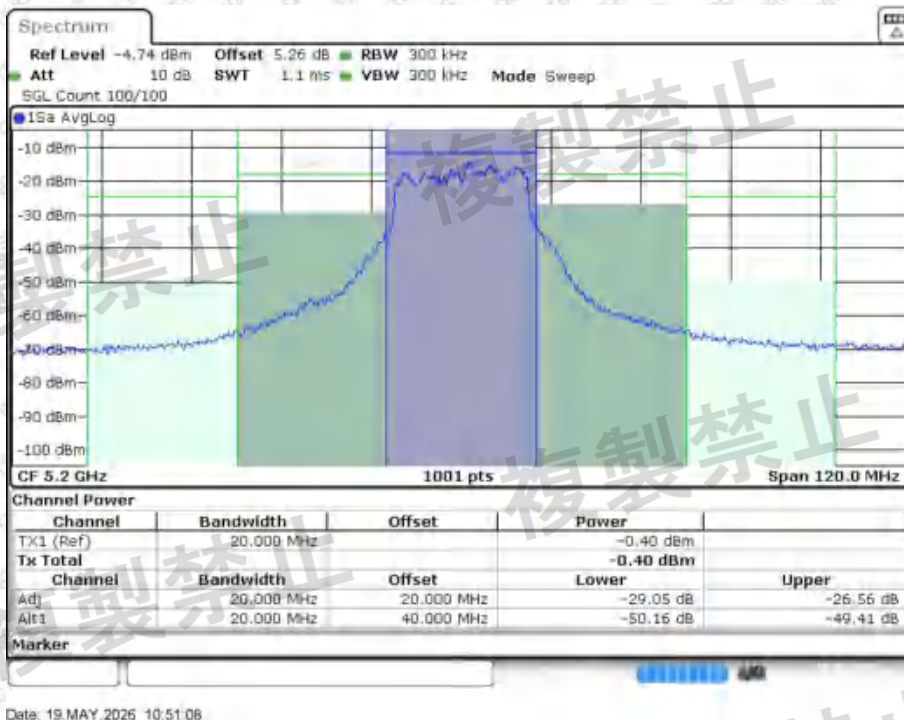


ACEP NVNT n20 5200MHz Ant2

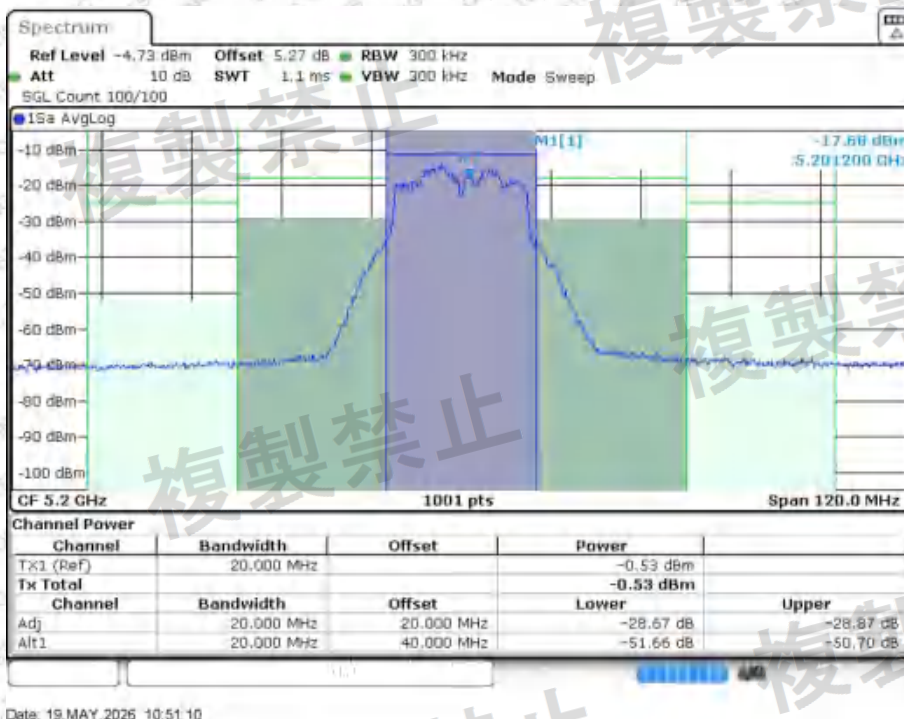




ACEP NVNT n20 5240MHz Ant1

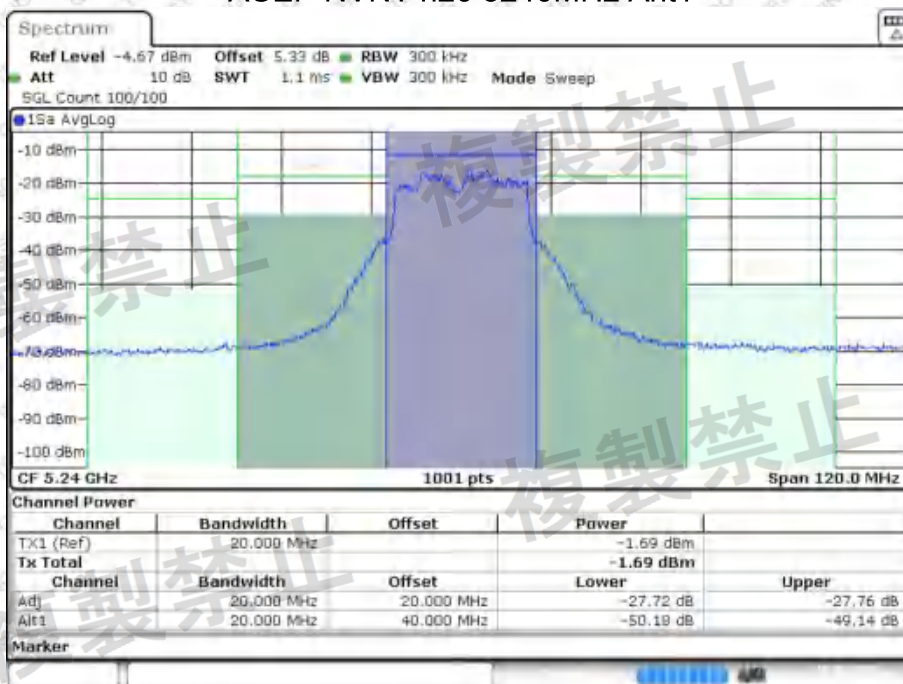

Date: 19.MAY.2025 10:53:52


ACEP NVNT n20 5240MHz Ant2

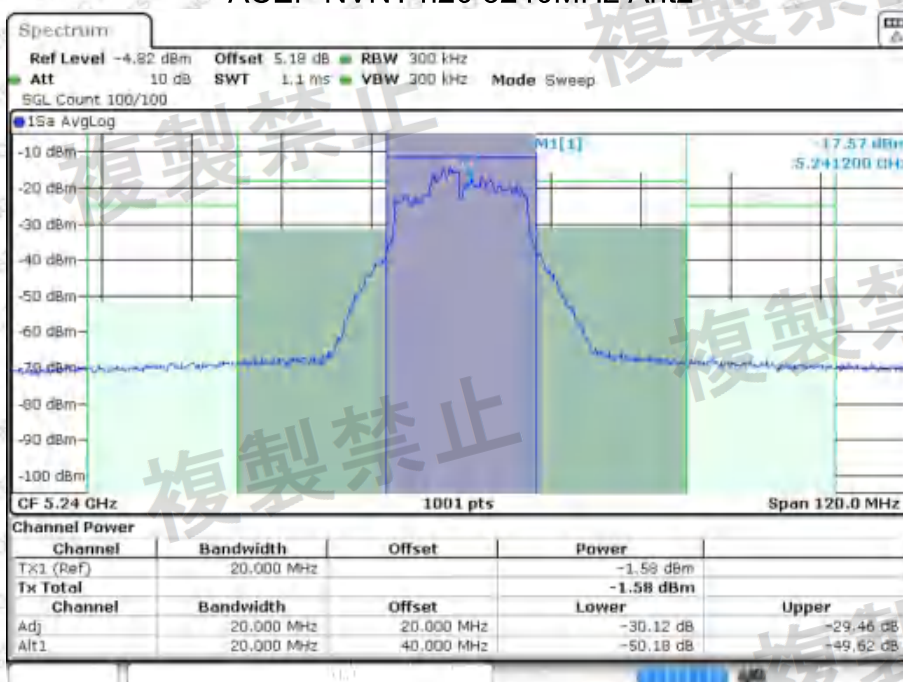

Date: 19.MAY.2025 10:53:54




ACEP NVNT n40 5190MHz Ant1

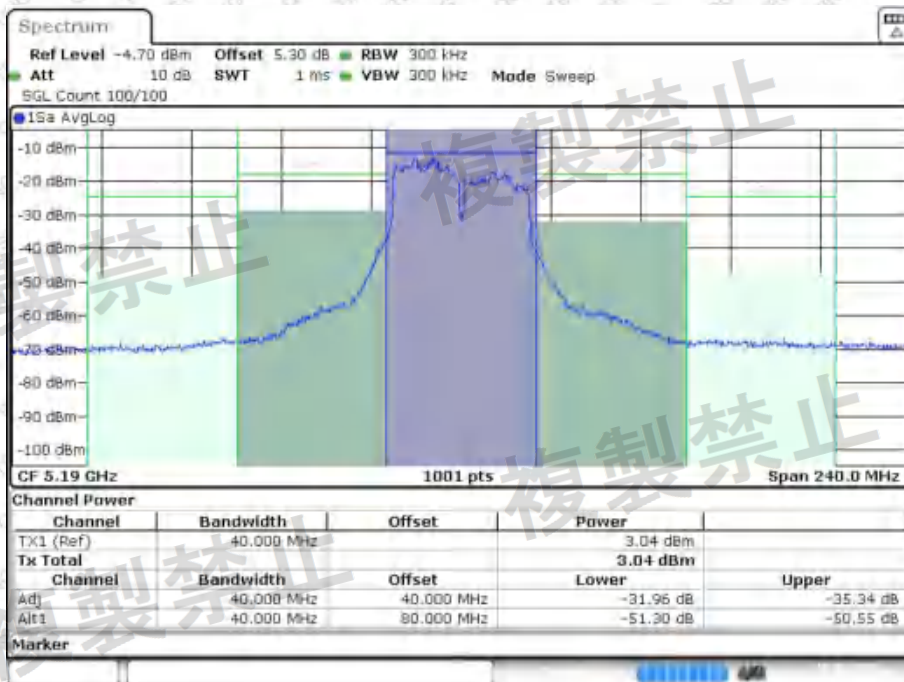

Date: 19.MAY.2025 10:57:22


ACEP NVNT n40 5190MHz Ant2

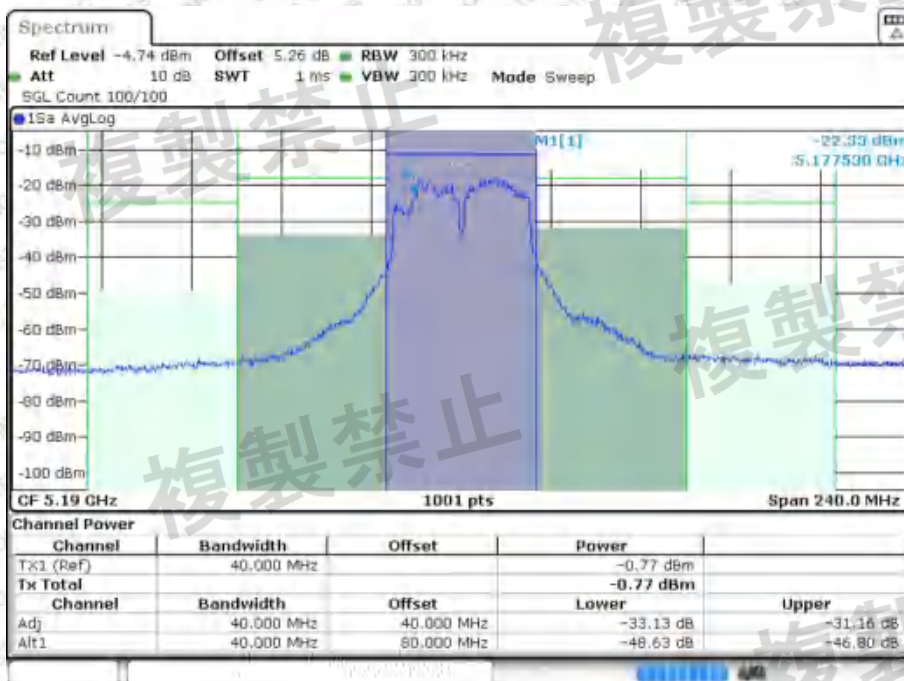


Date: 19.MAY.2025 10:57:24



ACEP NVNT n40 5230MHz Ant1

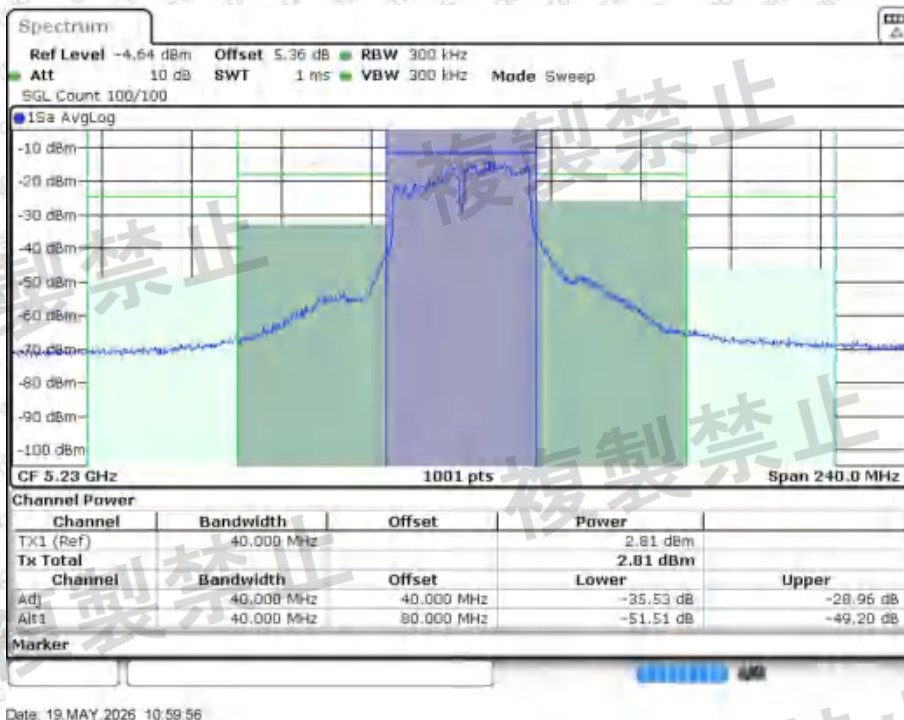


ACEP NVNT n40 5230MHz Ant2

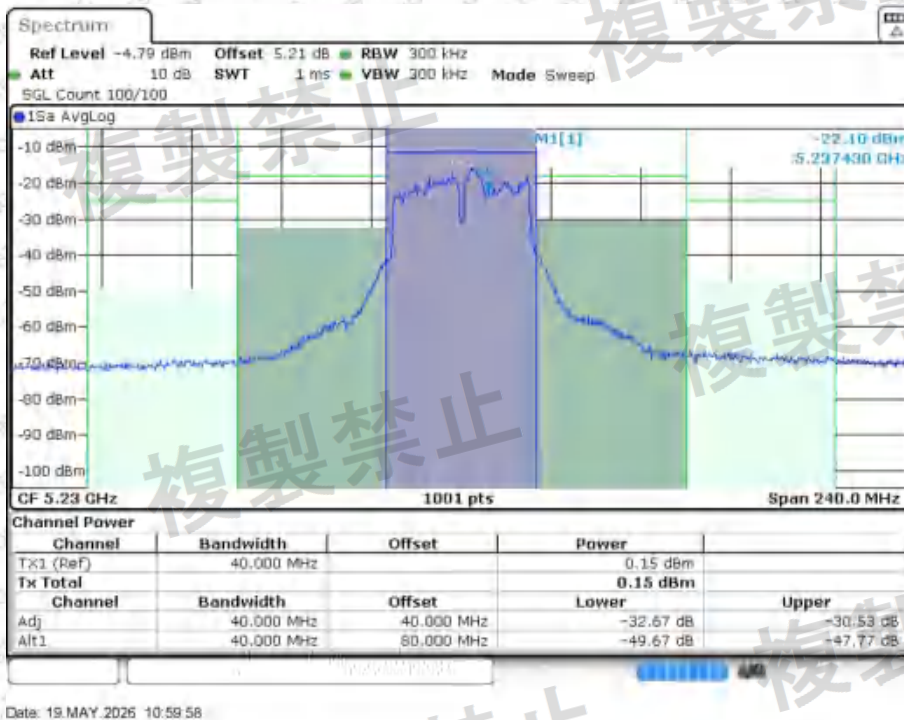




ACEP NVNT ac20 5180MHz Ant1

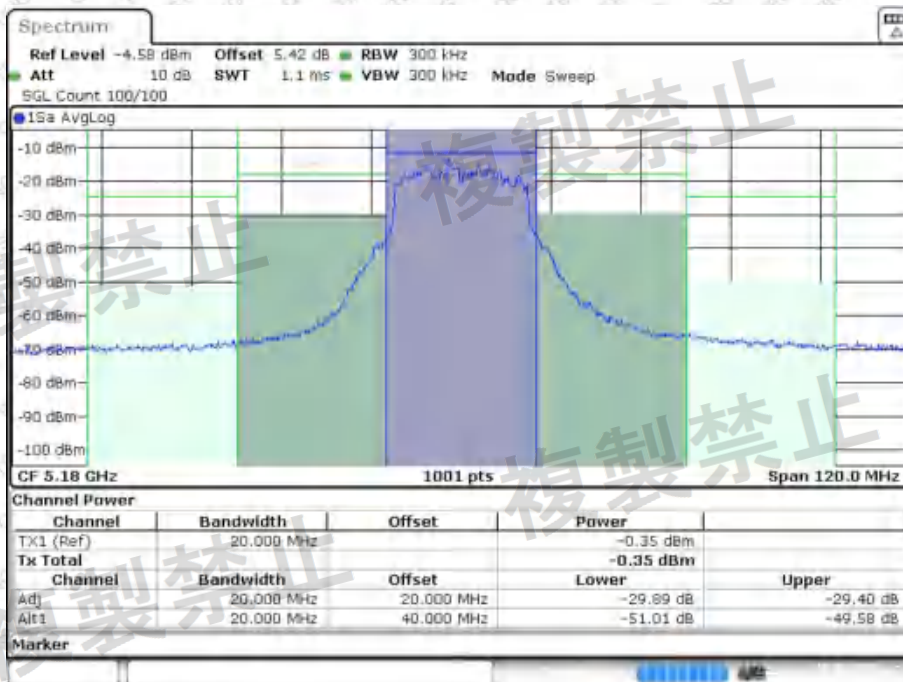

Date: 19.MAY.2025 11:13:05


ACEP NVNT ac20 5180MHz Ant2

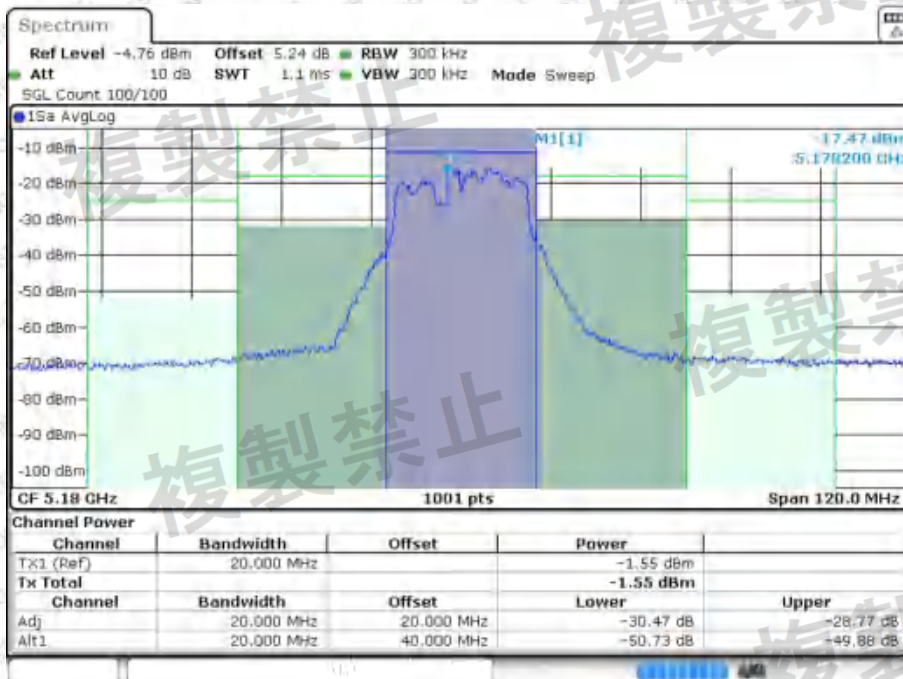

Date: 19.MAY.2025 11:13:08




ACEP NVNT ac20 5200MHz Ant1

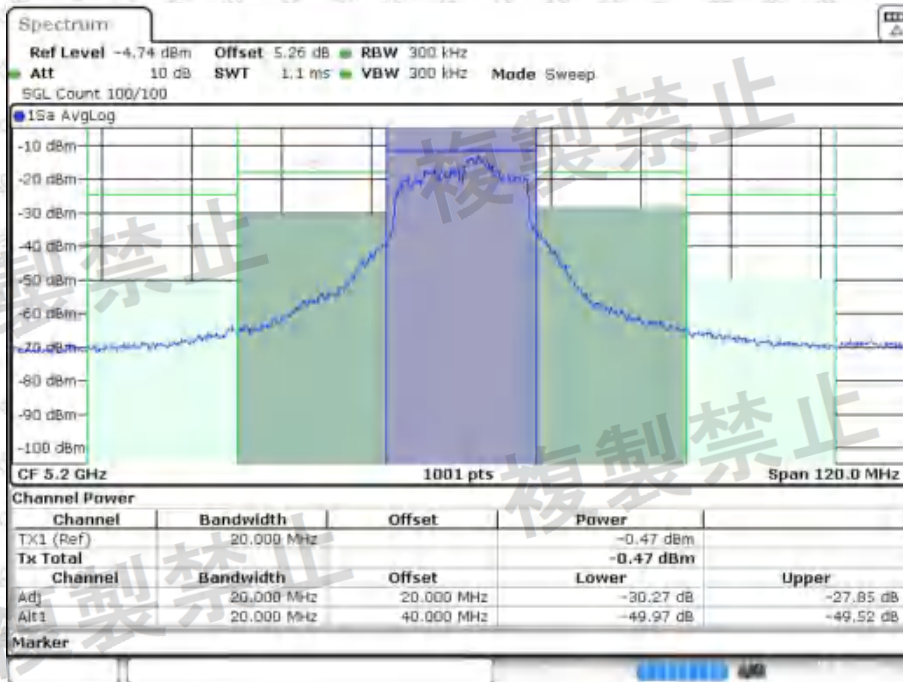

Date: 19.MAY.2025 11:16:15


ACEP NVNT ac20 5200MHz Ant2

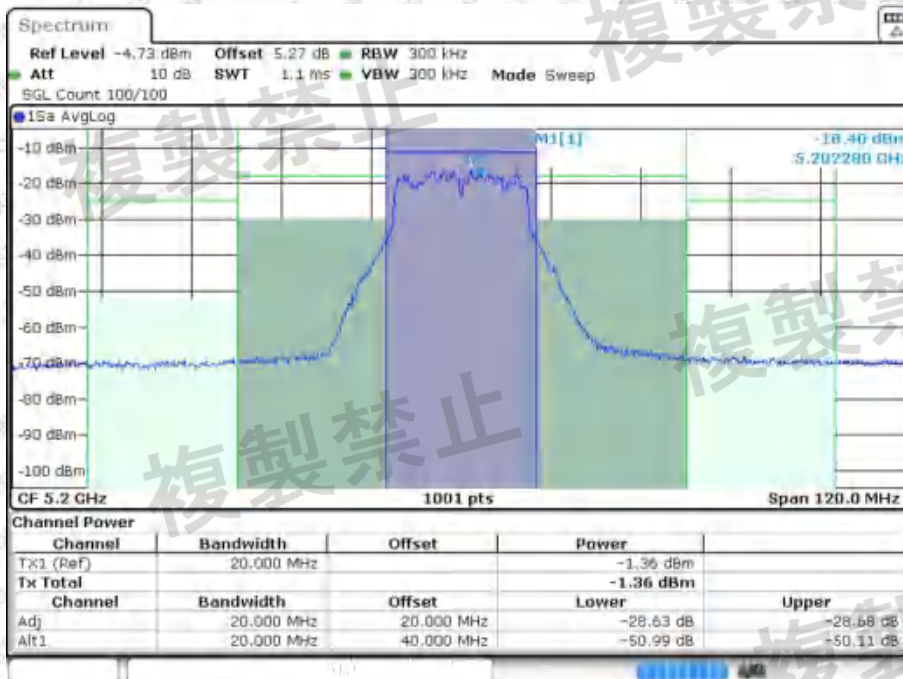

Date: 19.MAY.2025 11:16:17




ACEP NVNT ac20 5240MHz Ant1

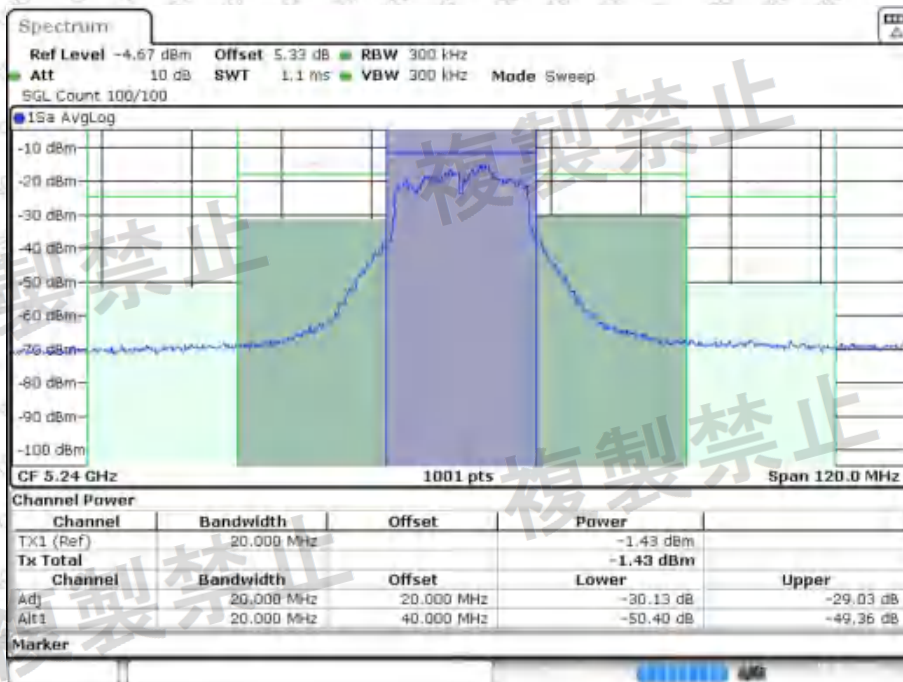

Date: 19.MAY.2025 11:19:39


ACEP NVNT ac20 5240MHz Ant2

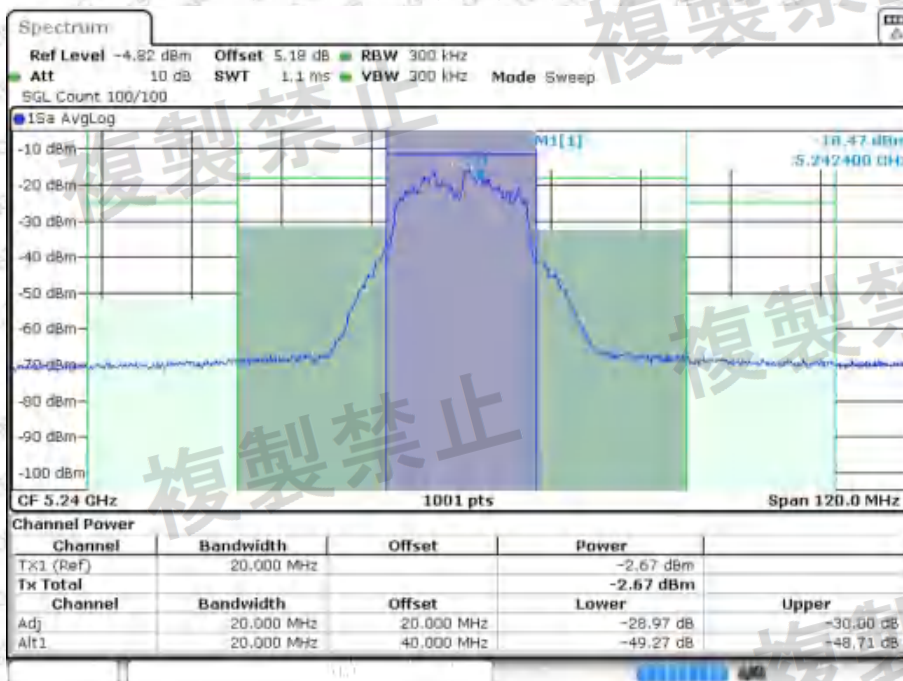

Date: 19.MAY.2025 11:19:41




ACEP NVNT ac40 5190MHz Ant1

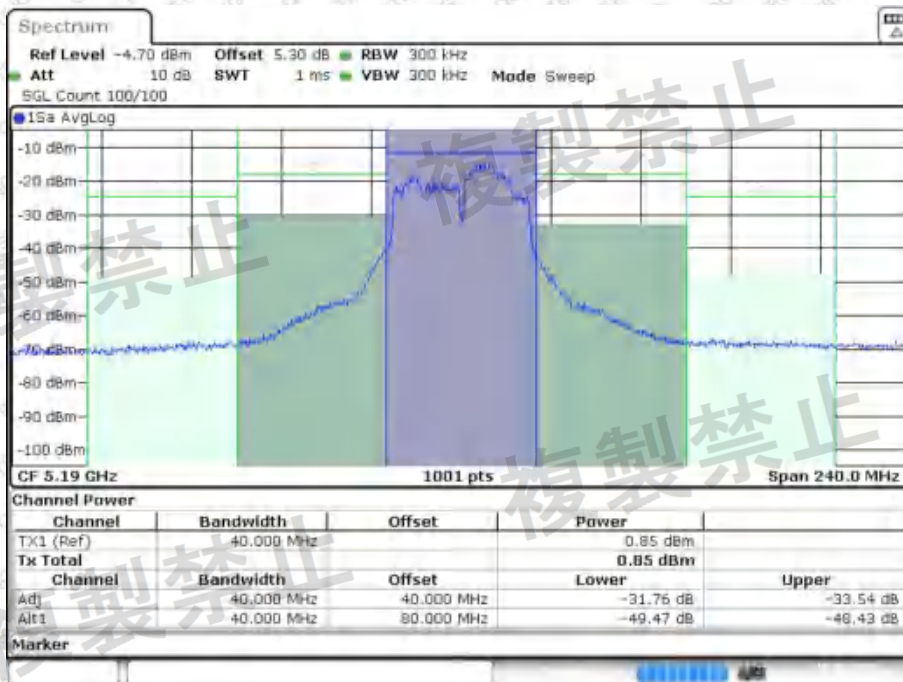

Date: 19.MAY.2025 11:23:19


ACEP NVNT ac40 5190MHz Ant2

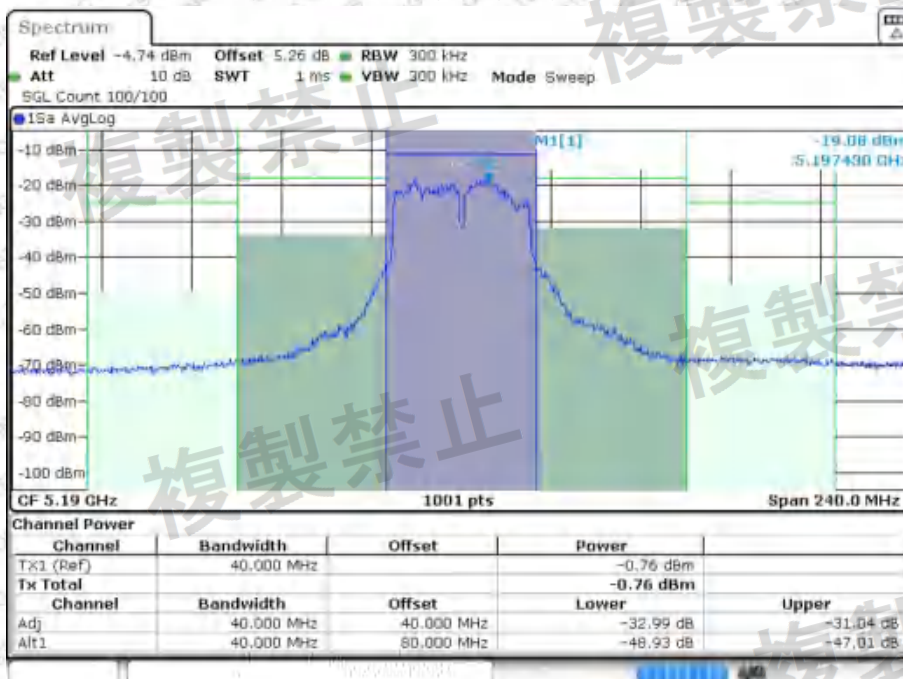

Date: 19.MAY.2025 11:23:21




ACEP NVNT ac40 5230MHz Ant1

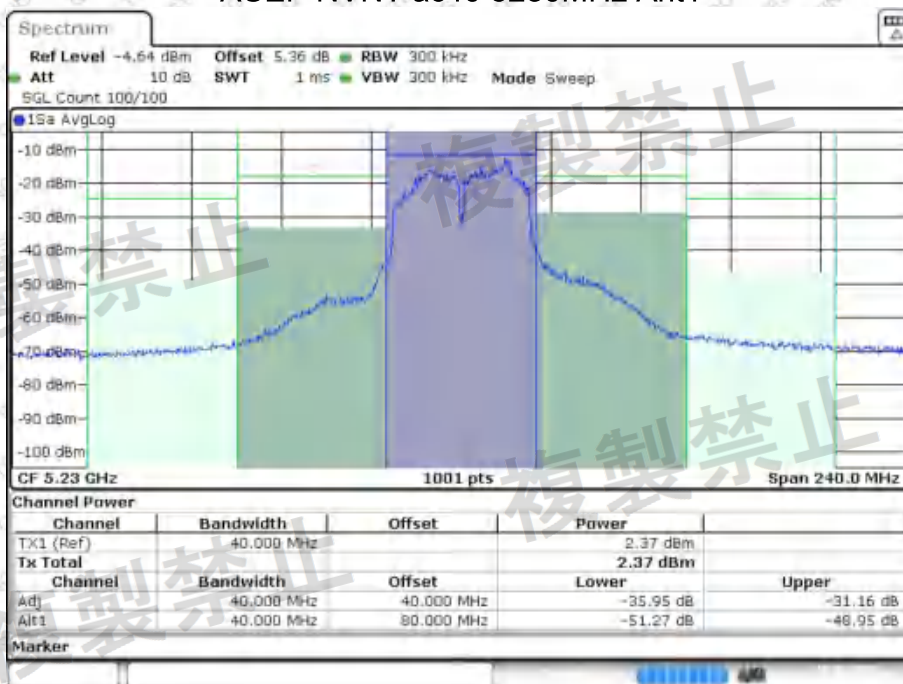

Date: 19.MAY.2025 11:26:53


ACEP NVNT ac40 5230MHz Ant2

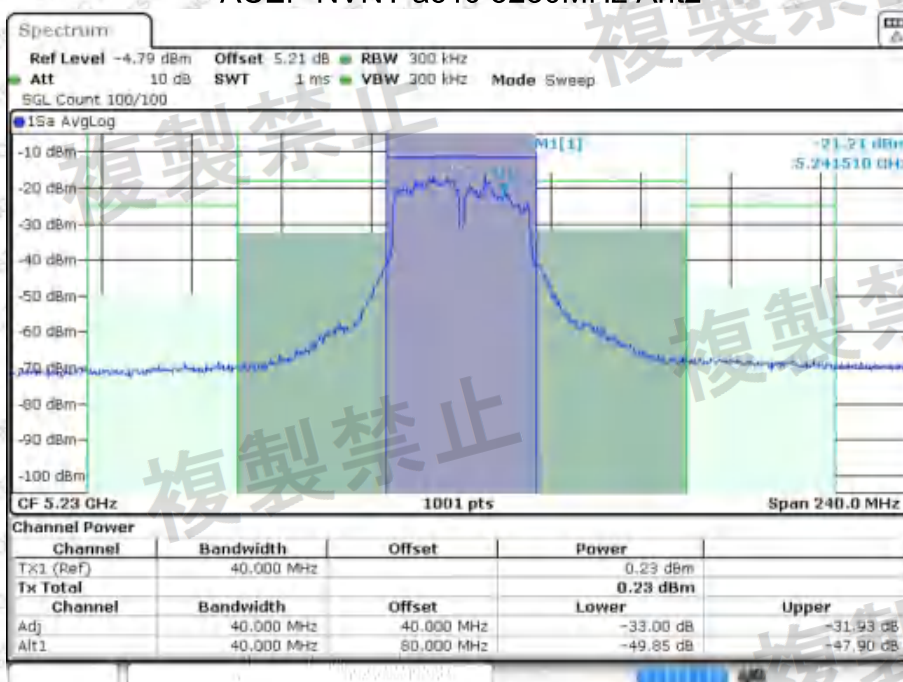

Date: 19.MAY.2025 11:26:55




ACEP NVNT ac80 5210MHz Ant1

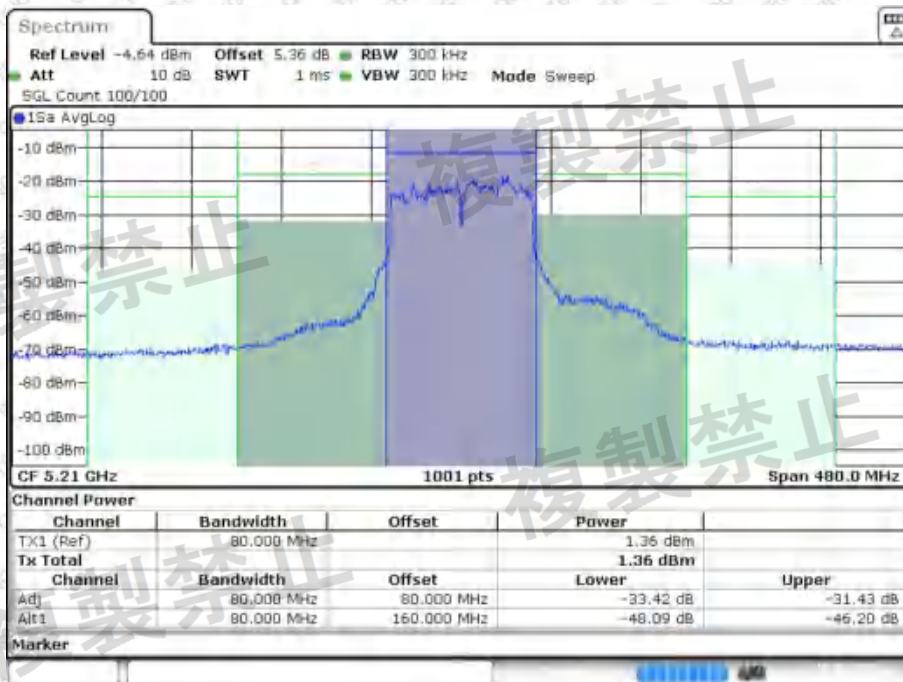

Date: 19.MAY.2025 11:57:14


ACEP NVNT ac80 5210MHz Ant2

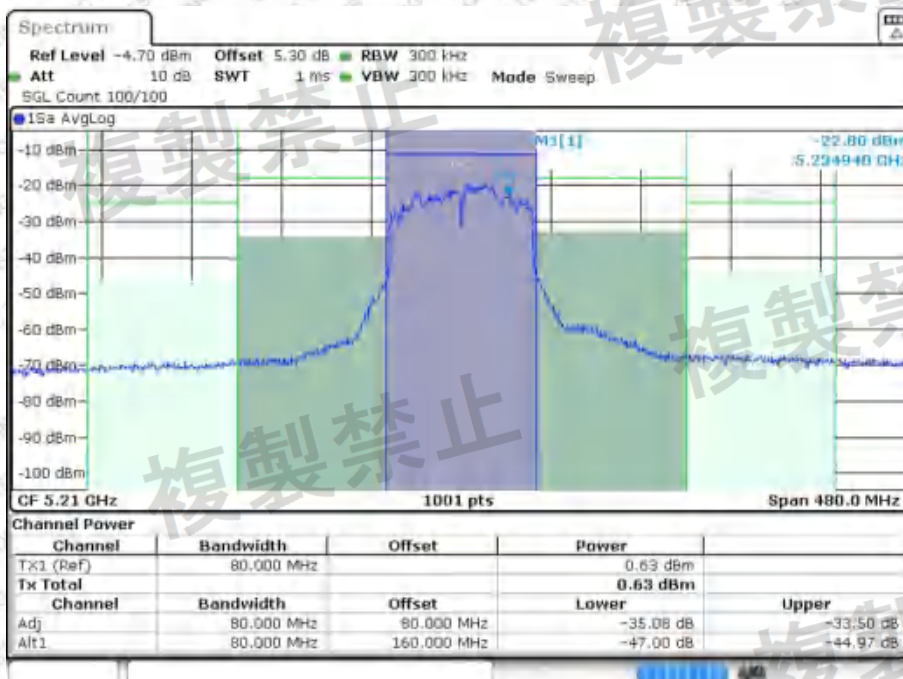

Date: 19.MAY.2025 11:57:17




ACEP NVNT ax20 5180MHz Ant1

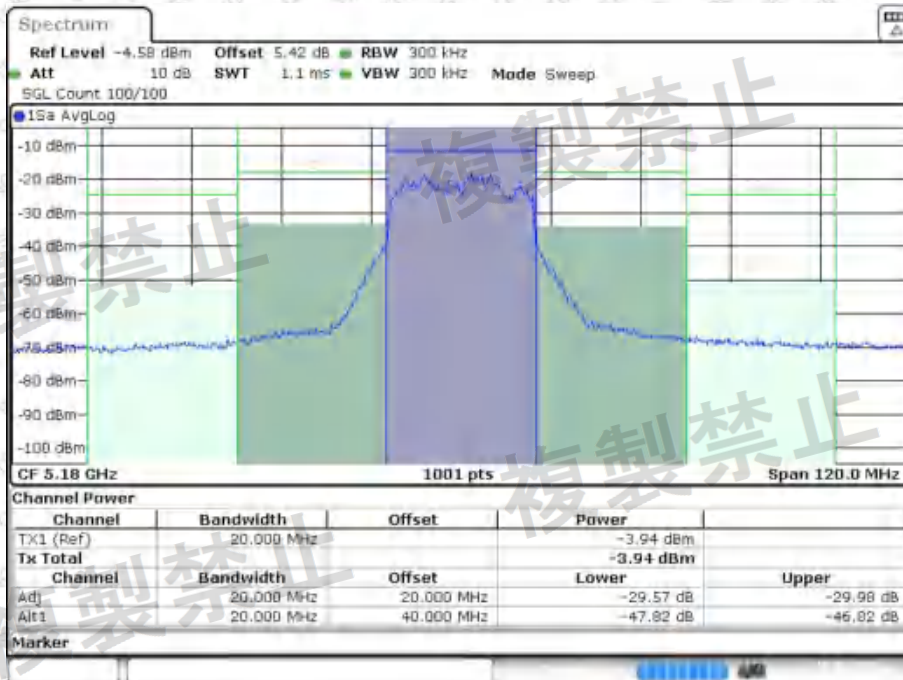

Date: 19.MAY.2025 14:24:38


ACEP NVNT ax20 5180MHz Ant2

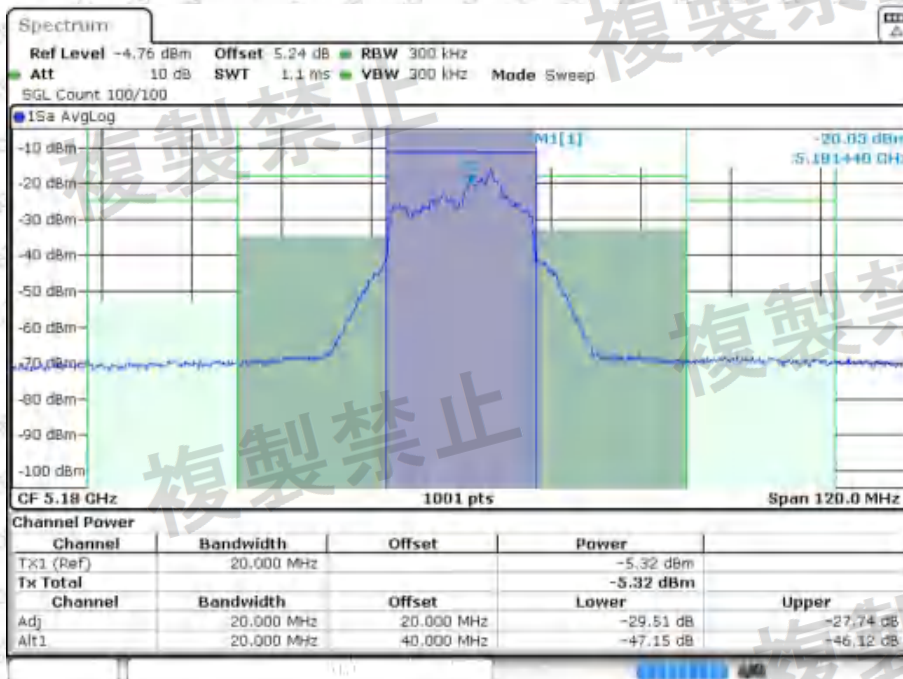


Date: 19.MAY.2025 14:24:40



ACEP NVNT ax20 5200MHz Ant1

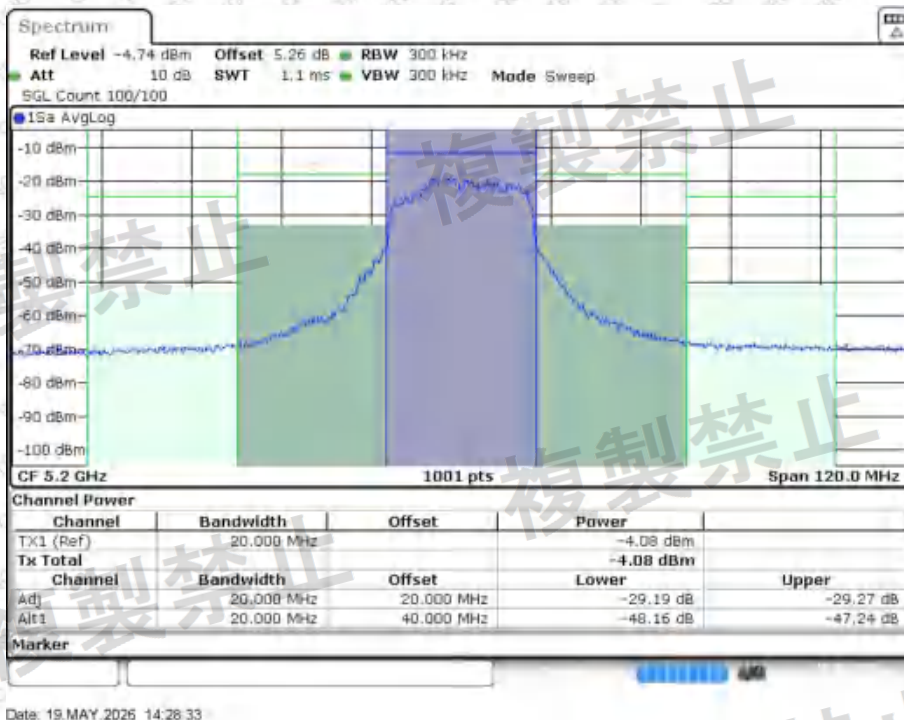


ACEP NVNT ax20 5200MHz Ant2

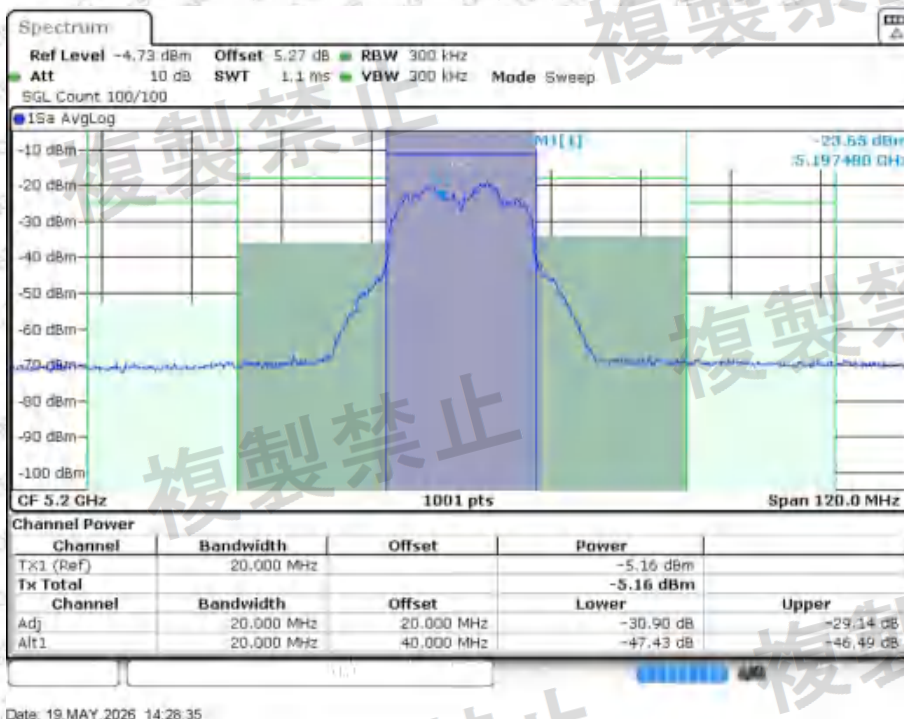




ACEP NVNT ax20 5240MHz Ant1

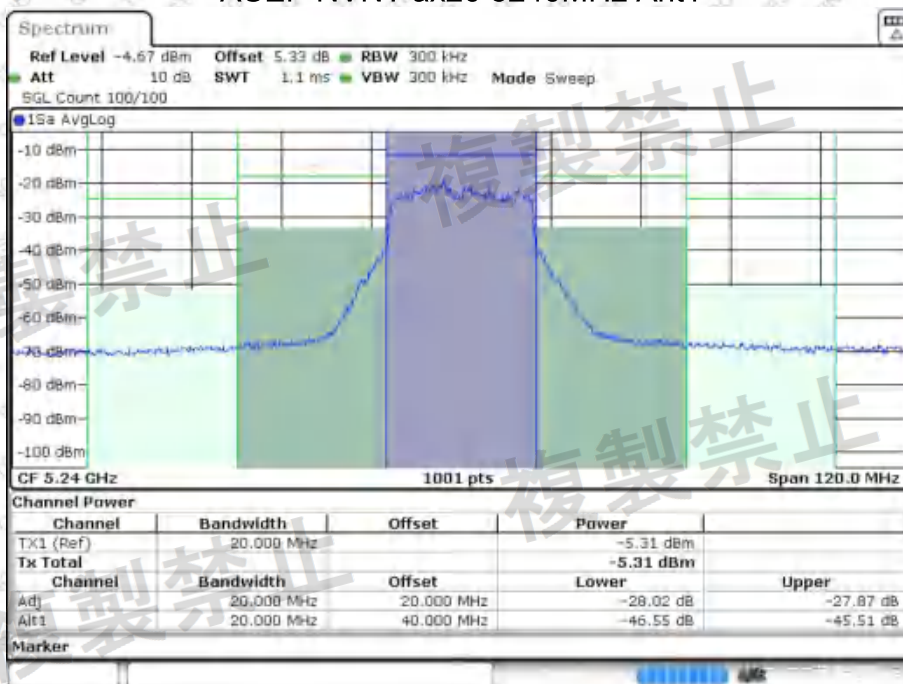

Date: 19.MAY.2025 14:20:19


ACEP NVNT ax20 5240MHz Ant2

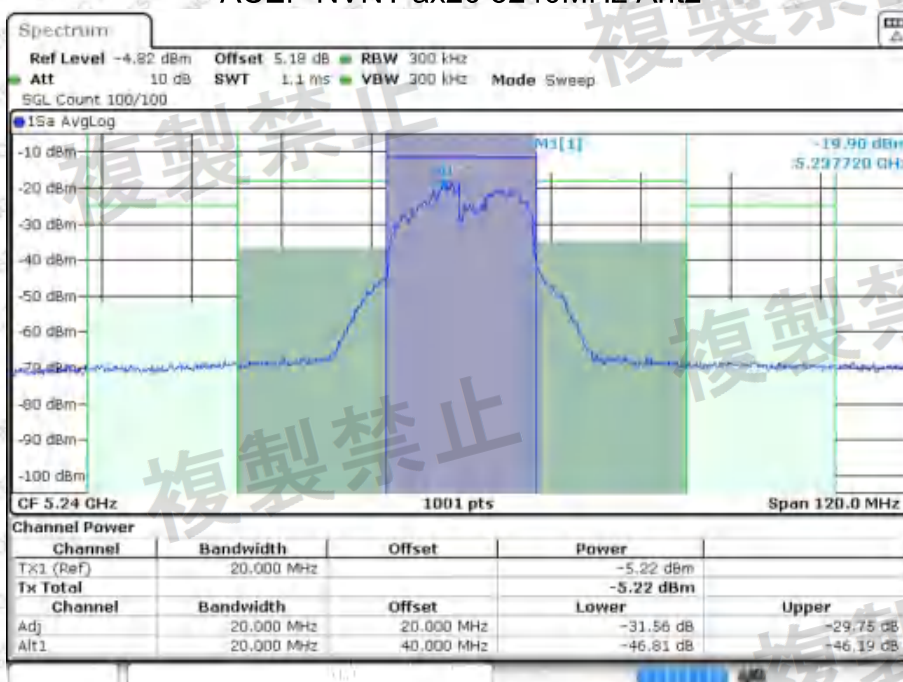

Date: 19.MAY.2025 14:20:21




ACEP NVNT ax40 5190MHz Ant1

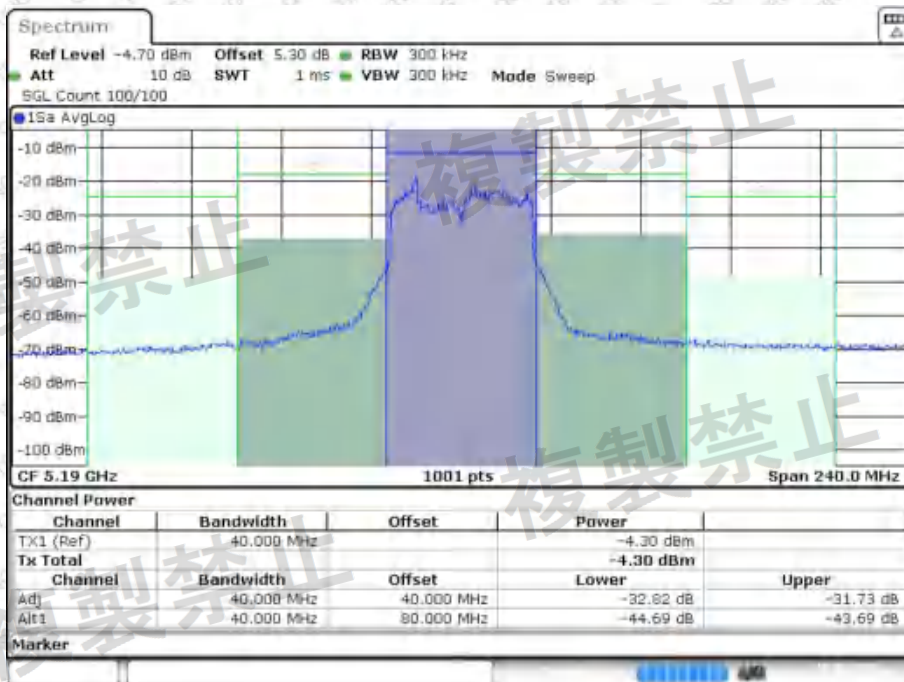

Date: 19.MAY.2025 14:34:00


ACEP NVNT ax40 5190MHz Ant2

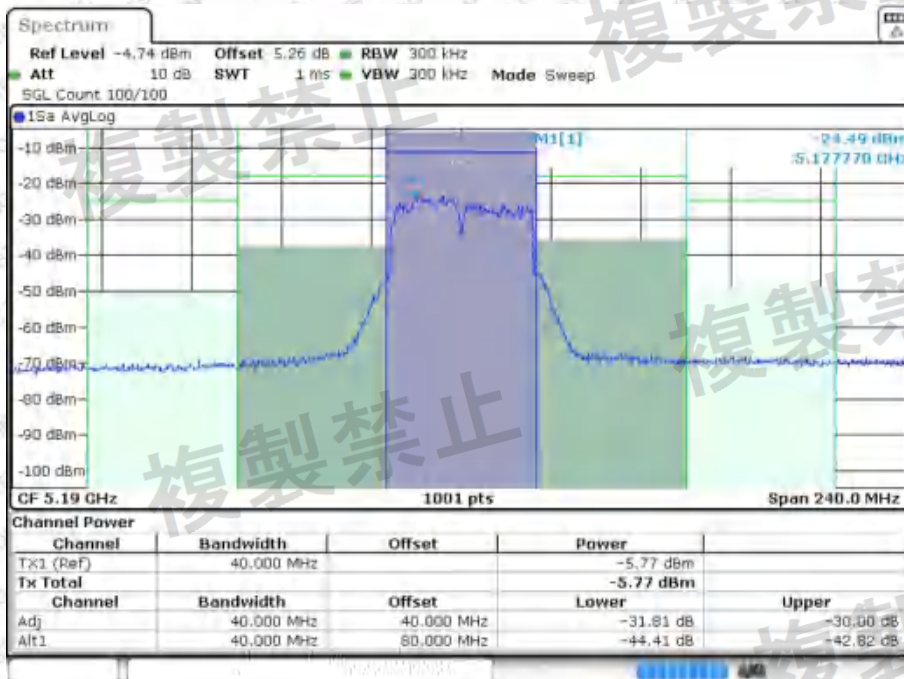

Date: 19.MAY.2025 14:34:02




ACEP NVNT ax40 5230MHz Ant1

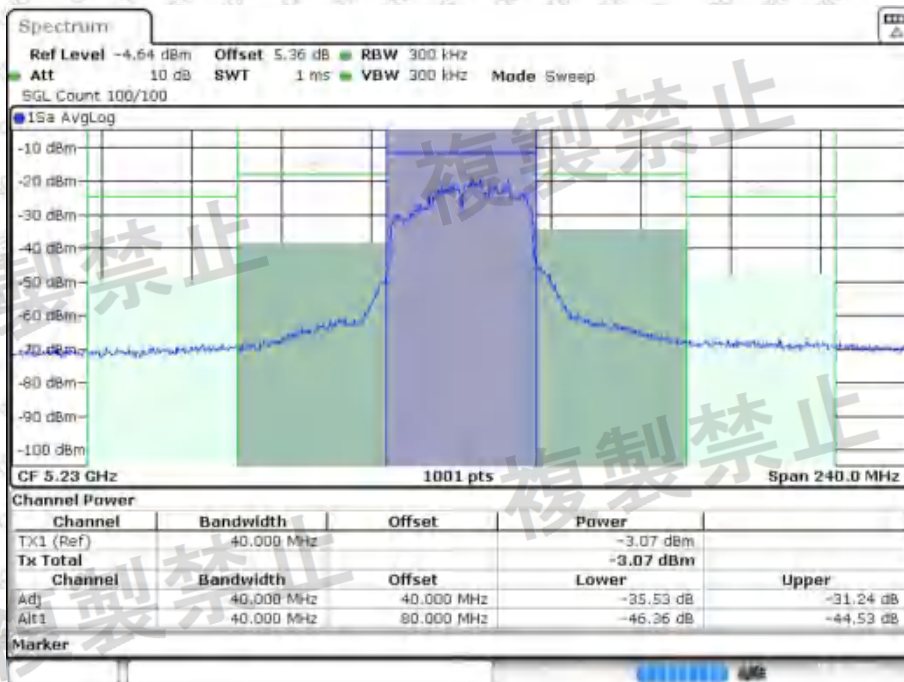

Date: 19.MAY.2025 14:37:10


ACEP NVNT ax40 5230MHz Ant2

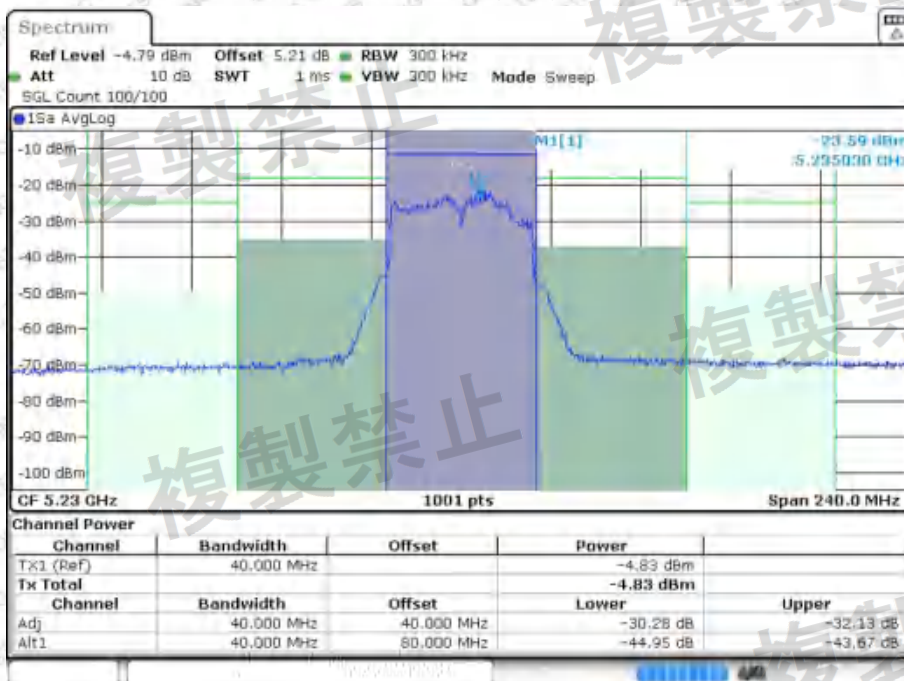

Date: 19.MAY.2025 14:37:12




ACEP NVNT ax80 5210MHz Ant1

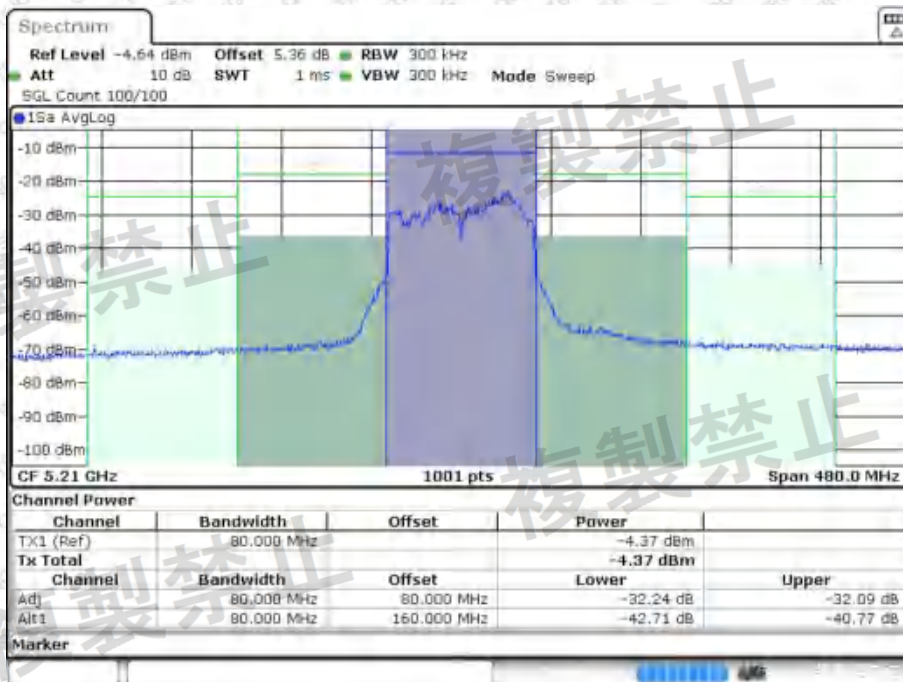

Date: 19.MAY.2025 14.40.22

ACEP NVNT ax80 5210MHz Ant2

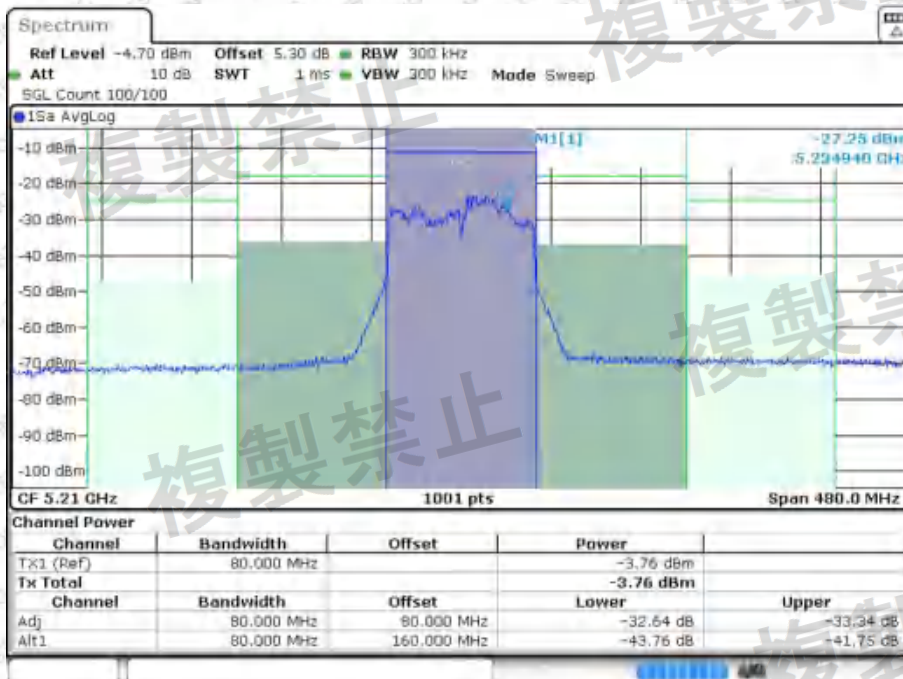

Date: 19.MAY.2025 14.40.25



W53:

Mode	Frequency (MHz)	Antenna	Offset (MHz)	Value (dBc)	Limit (dBc)	Verdict
a	5260	Ant1	-20	-27.99	-25	Pass
a	5260	Ant1	-40	-42.86	-40	Pass
a	5260	Ant1	20	-26.16	-25	Pass
a	5260	Ant1	40	-41.91	-40	Pass
a	5260	Ant2	-20	-30.53	-25	Pass
a	5260	Ant2	-40	-44.2	-40	Pass
a	5260	Ant2	20	-28.51	-25	Pass
a	5260	Ant2	40	-43.81	-40	Pass
a	5300	Ant1	-20	-27.76	-25	Pass
a	5300	Ant1	-40	-42.67	-40	Pass
a	5300	Ant1	20	-26.58	-25	Pass
a	5300	Ant1	40	-42.26	-40	Pass
a	5300	Ant2	-20	-28.27	-25	Pass
a	5300	Ant2	-40	-42.88	-40	Pass
a	5300	Ant2	20	-27.1	-25	Pass
a	5300	Ant2	40	-42.54	-40	Pass
a	5320	Ant1	-20	-29.46	-25	Pass
a	5320	Ant1	-40	-42.64	-40	Pass
a	5320	Ant1	20	-27.02	-25	Pass
a	5320	Ant1	40	-42.42	-40	Pass
a	5320	Ant2	-20	-29.85	-25	Pass
a	5320	Ant2	-40	-42.91	-40	Pass
a	5320	Ant2	20	-27.43	-25	Pass
a	5320	Ant2	40	-42.67	-40	Pass
n20	5260	Ant1	-20	-31.71	-25	Pass
n20	5260	Ant1	-40	-49.28	-40	Pass
n20	5260	Ant1	20	-29.25	-25	Pass
n20	5260	Ant1	40	-48.32	-40	Pass
n20	5260	Ant2	-20	-28.7	-25	Pass
n20	5260	Ant2	-40	-47.88	-40	Pass
n20	5260	Ant2	20	-28.34	-25	Pass
n20	5260	Ant2	40	-47.47	-40	Pass
n20	5300	Ant1	-20	-31.89	-25	Pass
n20	5300	Ant1	-40	-48.56	-40	Pass
n20	5300	Ant1	20	-29.56	-25	Pass
n20	5300	Ant1	40	-48.32	-40	Pass
n20	5300	Ant2	-20	-28.48	-25	Pass
n20	5300	Ant2	-40	-47.43	-40	Pass
n20	5300	Ant2	20	-27.99	-25	Pass
n20	5300	Ant2	40	-47.06	-40	Pass
n20	5320	Ant1	-20	-30.43	-25	Pass
n20	5320	Ant1	-40	-47.93	-40	Pass
n20	5320	Ant1	20	-30.05	-25	Pass
n20	5320	Ant1	40	-47.87	-40	Pass



n20	5320	Ant2	-20	-29.25	-25	Pass
n20	5320	Ant2	-40	-47.73	-40	Pass
n20	5320	Ant2	20	-27.89	-25	Pass
n20	5320	Ant2	40	-47.54	-40	Pass
n40	5270	Ant1	-40	-33.16	-25	Pass
n40	5270	Ant1	-80	-47.71	-40	Pass
n40	5270	Ant1	40	-33.38	-25	Pass
n40	5270	Ant1	80	-45.97	-40	Pass
n40	5270	Ant2	-40	-35.92	-25	Pass
n40	5270	Ant2	-80	-48.3	-40	Pass
n40	5270	Ant2	40	-34.42	-25	Pass
n40	5270	Ant2	80	-47.44	-40	Pass
n40	5310	Ant1	-40	-35.05	-25	Pass
n40	5310	Ant1	-80	-46.98	-40	Pass
n40	5310	Ant1	40	-34.16	-25	Pass
n40	5310	Ant1	80	-46.39	-40	Pass
n40	5310	Ant2	-40	-31.09	-25	Pass
n40	5310	Ant2	-80	-45.21	-40	Pass
n40	5310	Ant2	40	-32.68	-25	Pass
n40	5310	Ant2	80	-44.79	-40	Pass
ac20	5260	Ant1	-20	-31.36	-25	Pass
ac20	5260	Ant1	-40	-45.38	-40	Pass
ac20	5260	Ant1	20	-30.21	-25	Pass
ac20	5260	Ant1	40	-44.74	-40	Pass
ac20	5260	Ant2	-20	-27.72	-25	Pass
ac20	5260	Ant2	-40	-43.92	-40	Pass
ac20	5260	Ant2	20	-29.17	-25	Pass
ac20	5260	Ant2	40	-43.45	-40	Pass
ac20	5300	Ant1	-20	-27.62	-25	Pass
ac20	5300	Ant1	-40	-43.32	-40	Pass
ac20	5300	Ant1	20	-26.33	-25	Pass
ac20	5300	Ant1	40	-43.07	-40	Pass
ac20	5300	Ant2	-20	-25.09	-25	Pass
ac20	5300	Ant2	-40	-42.96	-40	Pass
ac20	5300	Ant2	20	-27.53	-25	Pass
ac20	5300	Ant2	40	-42.64	-40	Pass
ac20	5320	Ant1	-20	-27.39	-25	Pass
ac20	5320	Ant1	-40	-43.13	-40	Pass
ac20	5320	Ant1	20	-26.86	-25	Pass
ac20	5320	Ant1	40	-42.73	-40	Pass
ac20	5320	Ant2	-20	-27.9	-25	Pass
ac20	5320	Ant2	-40	-43.25	-40	Pass
ac20	5320	Ant2	20	-27.69	-25	Pass
ac20	5320	Ant2	40	-43.05	-40	Pass
ac40	5270	Ant1	-40	-32.32	-25	Pass
ac40	5270	Ant1	-80	-43.33	-40	Pass




ac40	5270	Ant1	40	-29.13	-25	Pass
ac40	5270	Ant1	80	-41.9	-40	Pass
ac40	5270	Ant2	-40	-32.67	-25	Pass
ac40	5270	Ant2	-80	-42.82	-40	Pass
ac40	5270	Ant2	40	-31.87	-25	Pass
ac40	5270	Ant2	80	-42.03	-40	Pass
ac40	5310	Ant1	-40	-27.66	-25	Pass
ac40	5310	Ant1	-80	-42.13	-40	Pass
ac40	5310	Ant1	40	-29.66	-25	Pass
ac40	5310	Ant1	80	-42.02	-40	Pass
ac40	5310	Ant2	-40	-31.82	-25	Pass
ac40	5310	Ant2	-80	-43.56	-40	Pass
ac40	5310	Ant2	40	-30.51	-25	Pass
ac40	5310	Ant2	80	-43.24	-40	Pass
ac80	5290	Ant1	-80	-32.72	-25	Pass
ac80	5290	Ant1	-160	-43.84	-40	Pass
ac80	5290	Ant1	80	-34.28	-25	Pass
ac80	5290	Ant1	160	-42.17	-40	Pass
ac80	5290	Ant2	-80	-32.29	-25	Pass
ac80	5290	Ant2	-160	-43.14	-40	Pass
ac80	5290	Ant2	80	-32.21	-25	Pass
ac80	5290	Ant2	160	-42.58	-40	Pass
ac160	5250	Ant1	-160	-36.43	-25	Pass
ac160	5250	Ant1	-320	-44.82	-40	Pass
ac160	5250	Ant1	160	-34.93	-25	Pass
ac160	5250	Ant1	320	-41.91	-40	Pass
ac160	5250	Ant2	-160	-36.47	-25	Pass
ac160	5250	Ant2	-320	-43.43	-40	Pass
ac160	5250	Ant2	160	-34.98	-25	Pass
ac160	5250	Ant2	320	-41.28	-40	Pass
ax20	5260	Ant1	-20	-33.59	-25	Pass
ax20	5260	Ant1	-40	-46.85	-40	Pass
ax20	5260	Ant1	20	-28.91	-25	Pass
ax20	5260	Ant1	40	-45.99	-40	Pass
ax20	5260	Ant2	-20	-31.05	-25	Pass
ax20	5260	Ant2	-40	-45.3	-40	Pass
ax20	5260	Ant2	20	-28.26	-25	Pass
ax20	5260	Ant2	40	-44.79	-40	Pass
ax20	5300	Ant1	-20	-26.83	-25	Pass
ax20	5300	Ant1	-40	-43.37	-40	Pass
ax20	5300	Ant1	20	-26.68	-25	Pass
ax20	5300	Ant1	40	-43.19	-40	Pass
ax20	5300	Ant2	-20	-27.96	-25	Pass
ax20	5300	Ant2	-40	-43.84	-40	Pass
ax20	5300	Ant2	20	-28.49	-25	Pass
ax20	5300	Ant2	40	-43.47	-40	Pass



ax20	5320	Ant1	-20	-29.81	-25	Pass
ax20	5320	Ant1	-40	-44.16	-40	Pass
ax20	5320	Ant1	20	-29.36	-25	Pass
ax20	5320	Ant1	40	-43.8	-40	Pass
ax20	5320	Ant2	-20	-27.66	-25	Pass
ax20	5320	Ant2	-40	-43.46	-40	Pass
ax20	5320	Ant2	20	-26.7	-25	Pass
ax20	5320	Ant2	40	-43.11	-40	Pass
ax40	5270	Ant1	-40	-30.88	-25	Pass
ax40	5270	Ant1	-80	-43.14	-40	Pass
ax40	5270	Ant1	40	-28.98	-25	Pass
ax40	5270	Ant1	80	-41.65	-40	Pass
ax40	5270	Ant2	-40	-30.81	-25	Pass
ax40	5270	Ant2	-80	-42.79	-40	Pass
ax40	5270	Ant2	40	-31.75	-25	Pass
ax40	5270	Ant2	80	-42.02	-40	Pass
ax40	5310	Ant1	-40	-31.21	-25	Pass
ax40	5310	Ant1	-80	-43.19	-40	Pass
ax40	5310	Ant1	40	-33.48	-25	Pass
ax40	5310	Ant1	80	-43	-40	Pass
ax40	5310	Ant2	-40	-30.99	-25	Pass
ax40	5310	Ant2	-80	-42.12	-40	Pass
ax40	5310	Ant2	40	-30.47	-25	Pass
ax40	5310	Ant2	80	-41.41	-40	Pass
ax80	5290	Ant1	-80	-32.38	-25	Pass
ax80	5290	Ant1	-160	-42.96	-40	Pass
ax80	5290	Ant1	80	-31.98	-25	Pass
ax80	5290	Ant1	160	-41.36	-40	Pass
ax80	5290	Ant2	-80	-33.13	-25	Pass
ax80	5290	Ant2	-160	-43.14	-40	Pass
ax80	5290	Ant2	80	-31.96	-25	Pass
ax80	5290	Ant2	160	-42.31	-40	Pass
ax160	5250	Ant1	-160	-37.89	-25	Pass
ax160	5250	Ant1	-320	-45.07	-40	Pass
ax160	5250	Ant1	160	-35.79	-25	Pass
ax160	5250	Ant1	320	-42.28	-40	Pass
ax160	5250	Ant2	-160	-37.82	-25	Pass
ax160	5250	Ant2	-320	-44.09	-40	Pass
ax160	5250	Ant2	160	-36.11	-25	Pass
ax160	5250	Ant2	320	-41.69	-40	Pass




ACEP NVNT a 5260MHz Ant1

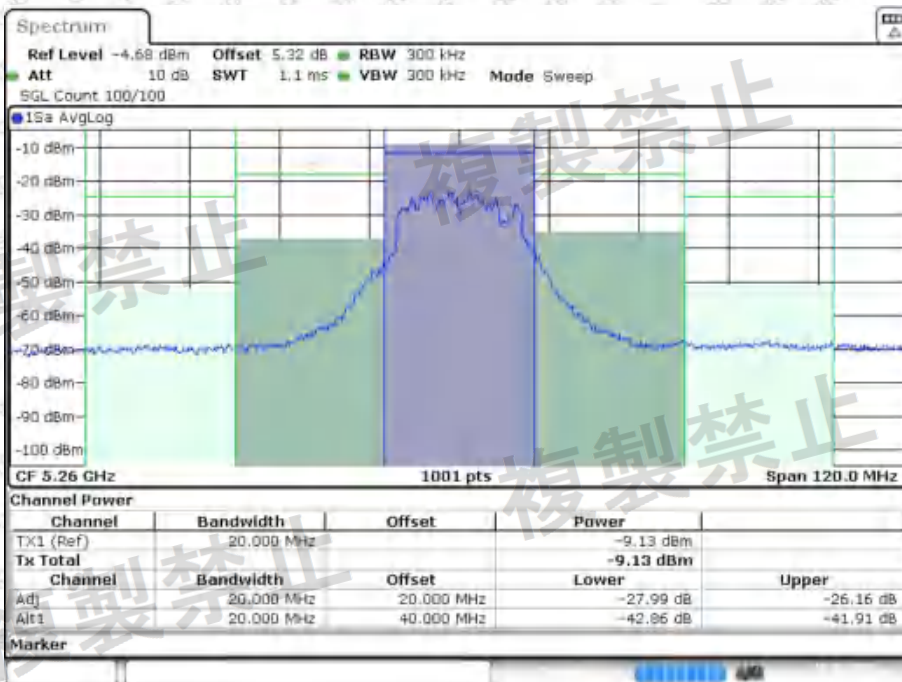

Date: 19.MAY.2025 15:12:46


ACEP NVNT a 5260MHz Ant2

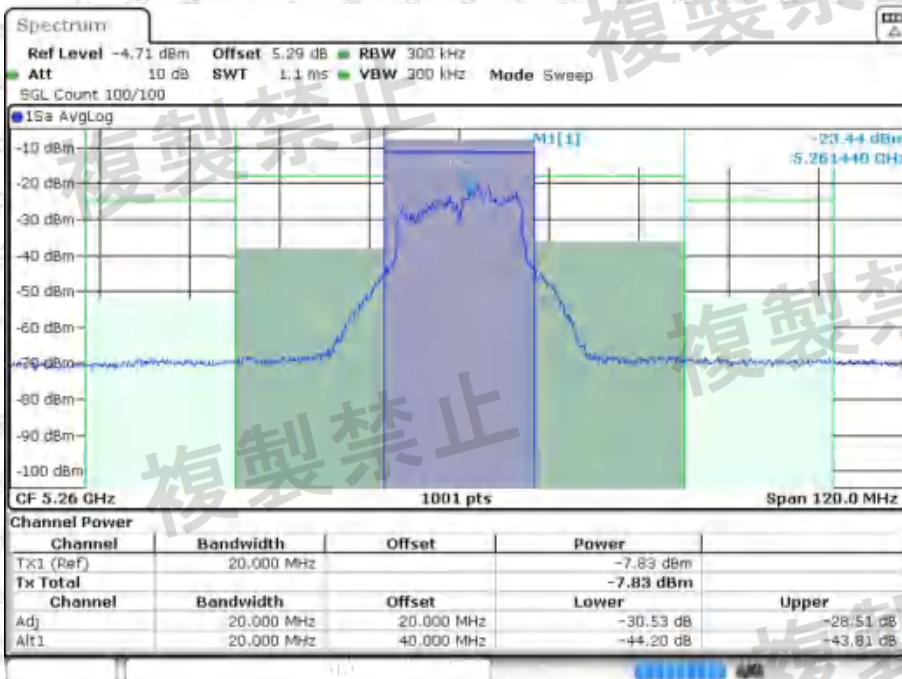

Date: 19.MAY.2025 15:12:48




ACEP NVNT a 5300MHz Ant1

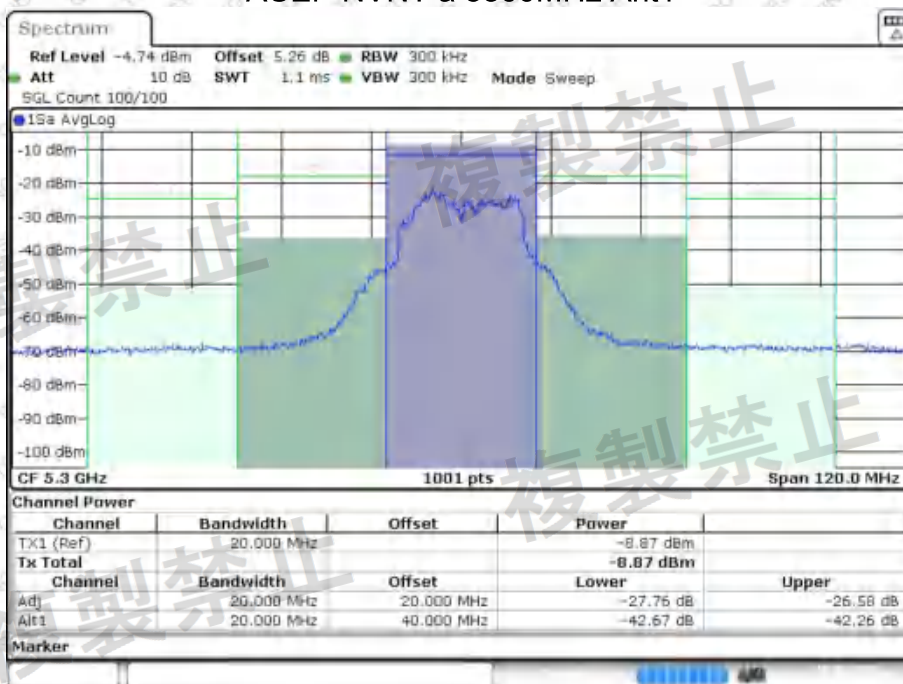

Date: 19.MAY.2025 15:09:55


ACEP NVNT a 5300MHz Ant2

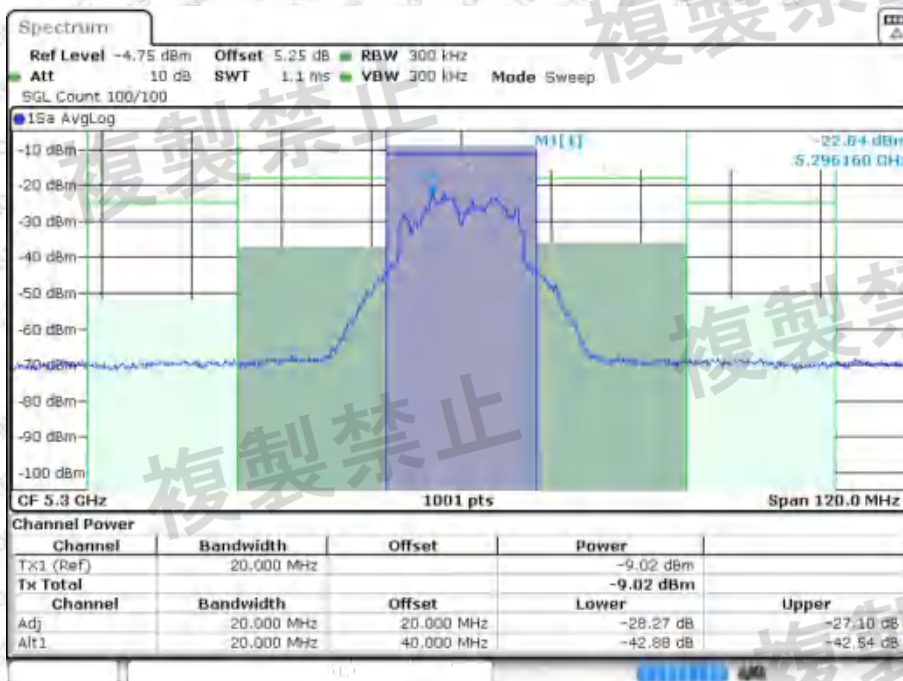

Date: 19.MAY.2025 15:09:57




ACEP NVNT a 5320MHz Ant1

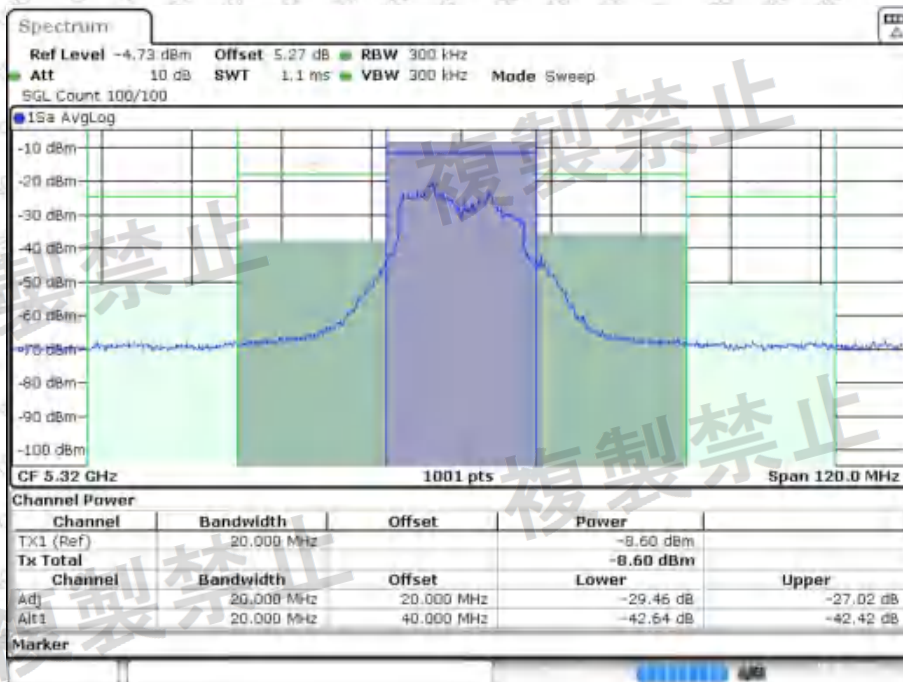

Date: 19.MAY.2025 15:06:22


ACEP NVNT a 5320MHz Ant2

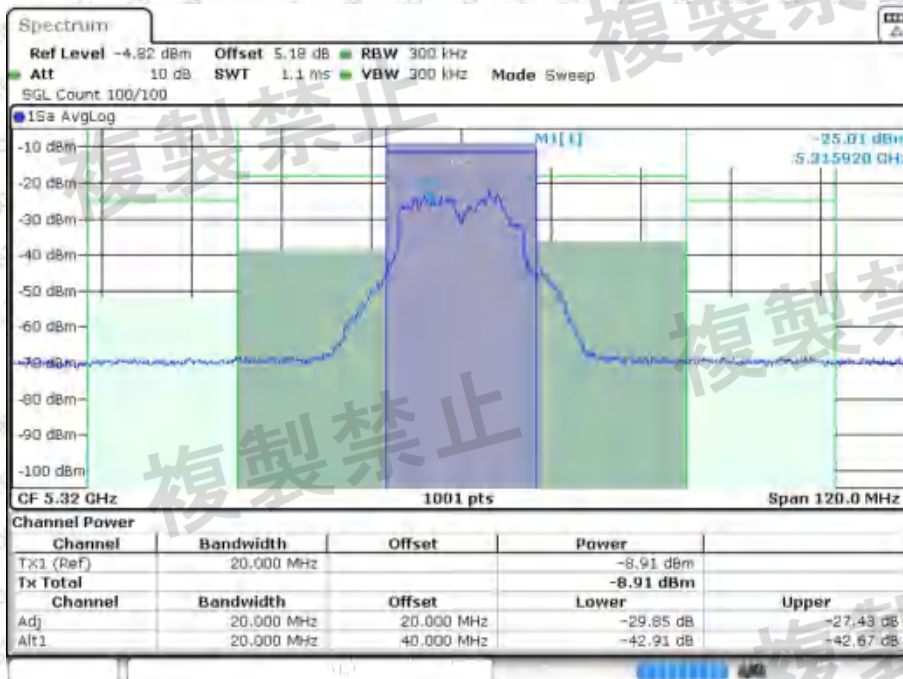

Date: 19.MAY.2025 15:06:24




ACEP NVNT ac20 5260MHz Ant1

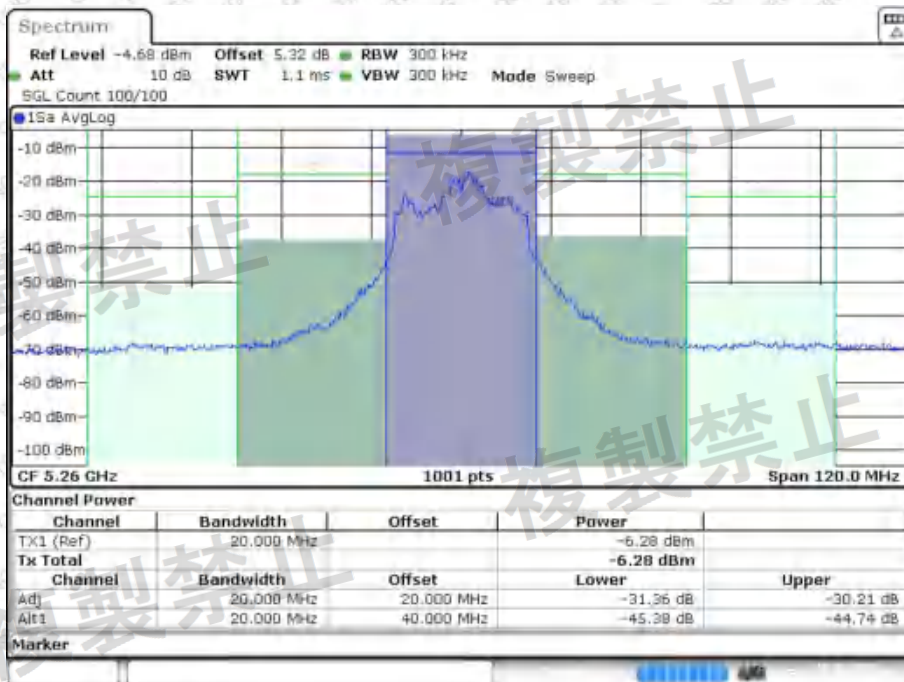

Date: 19.MAY.2025 15:34:51


ACEP NVNT ac20 5260MHz Ant2

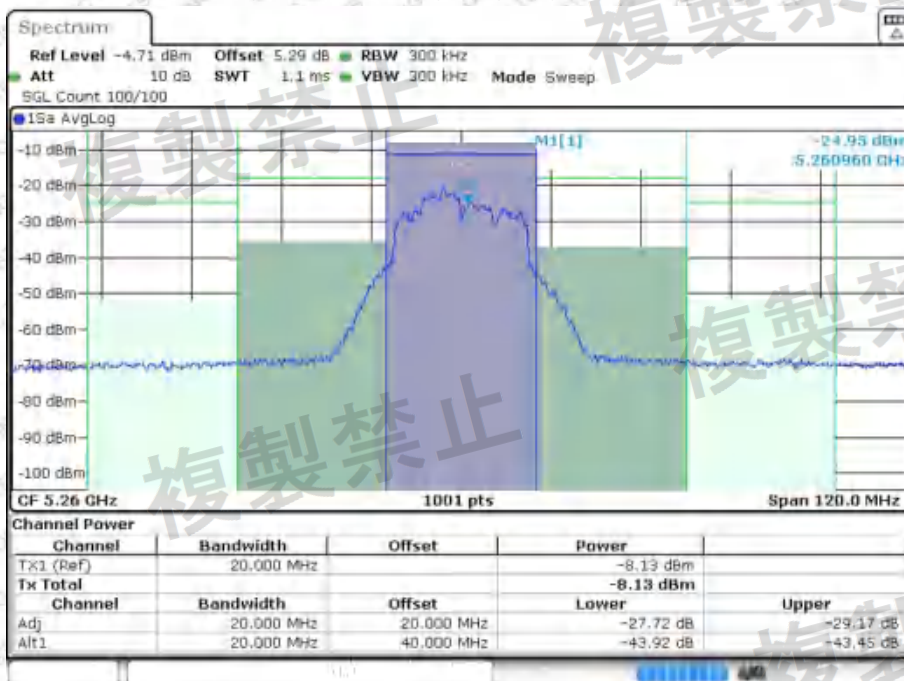

Date: 19.MAY.2025 15:34:53




ACEP NVNT ac20 5300MHz Ant1

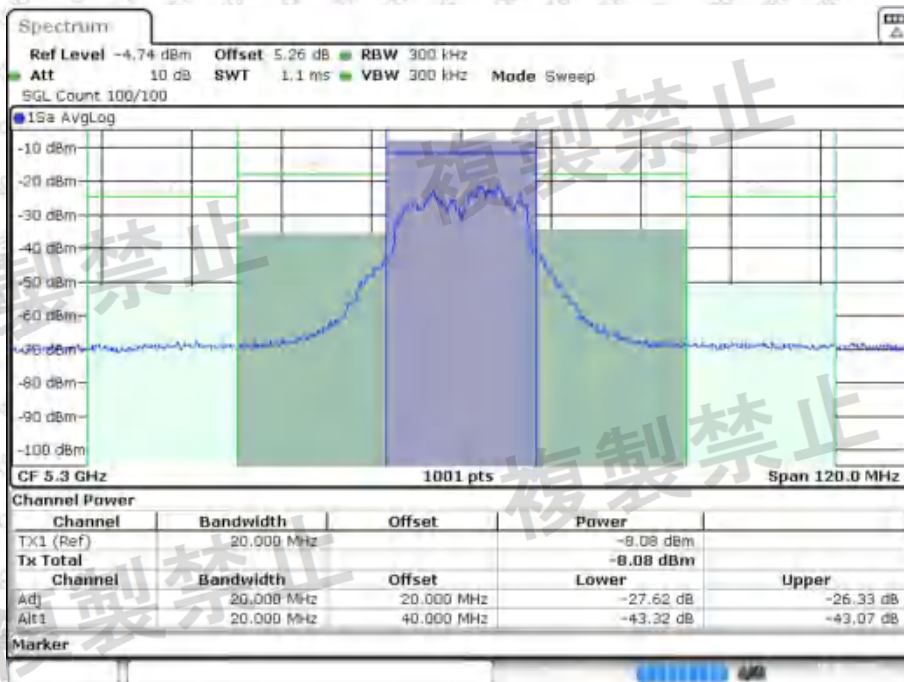

Date: 19.MAY.2025 15:37:43


ACEP NVNT ac20 5300MHz Ant2

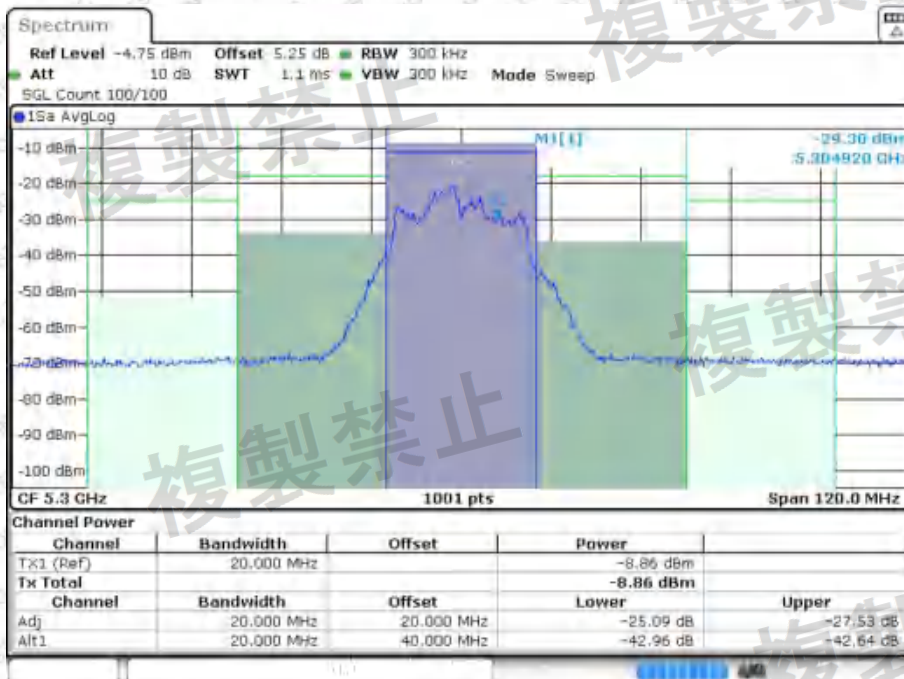

Date: 19.MAY.2025 15:37:45




ACEP NVNT ac20 5320MHz Ant1

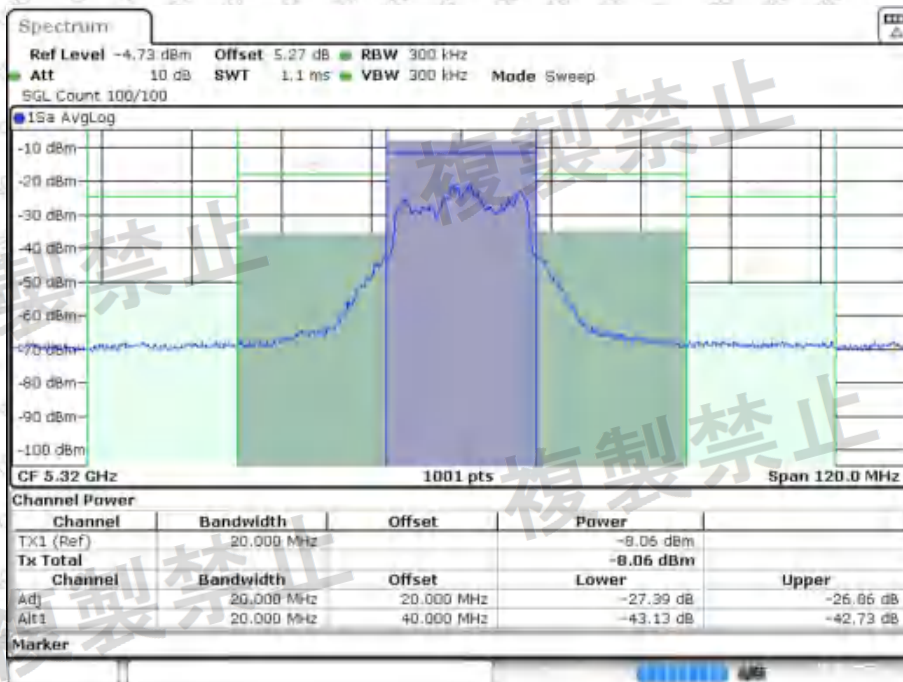

Date: 19.MAY.2025 15:40:33


ACEP NVNT ac20 5320MHz Ant2

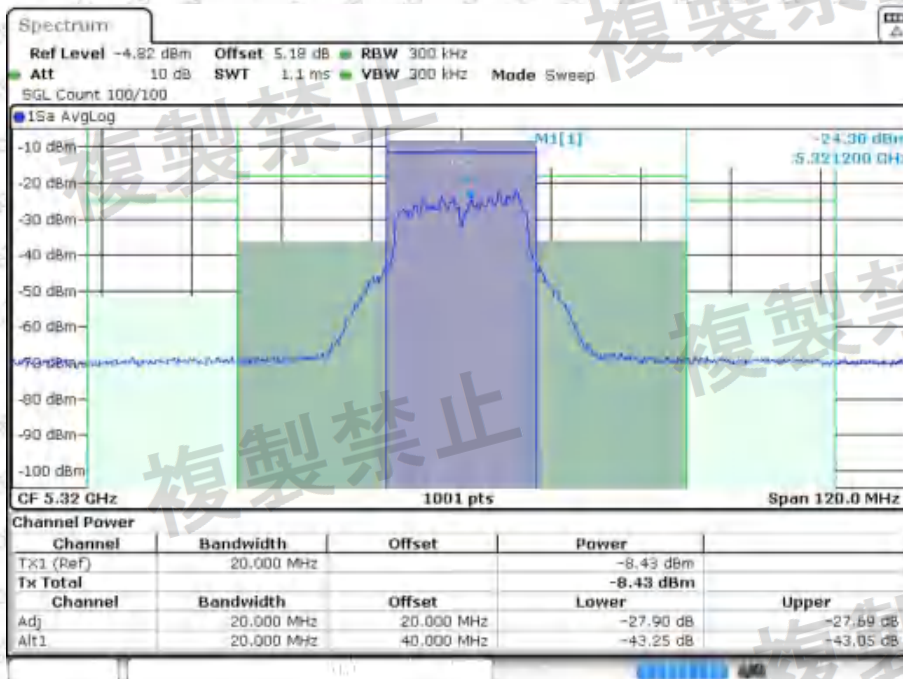


Date: 19.MAY.2025 15:40:35



ACEP NVNT ac40 5270MHz Ant1

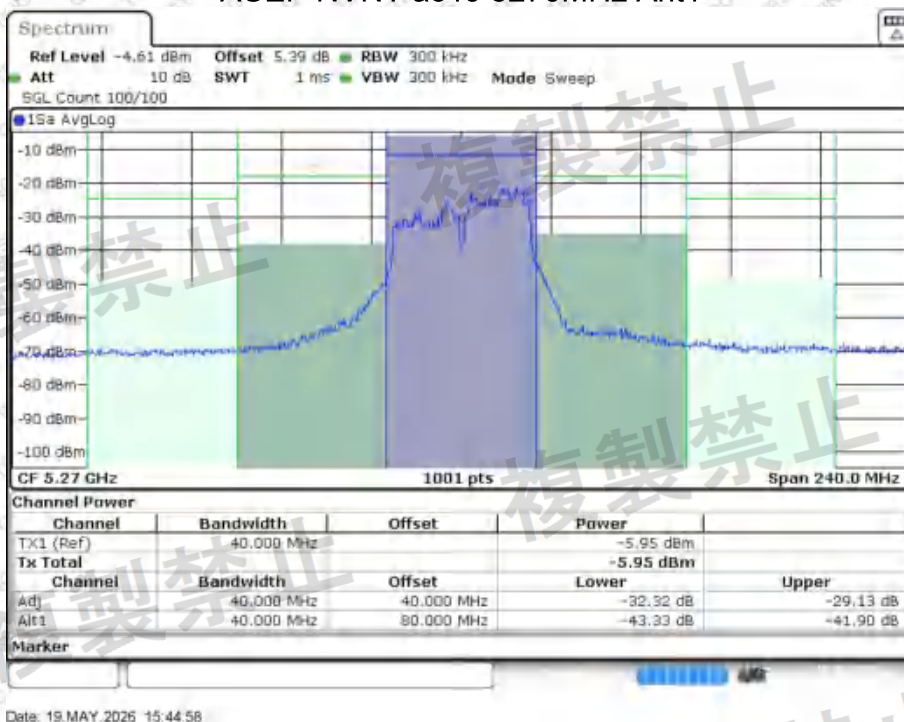


ACEP NVNT ac40 5270MHz Ant2

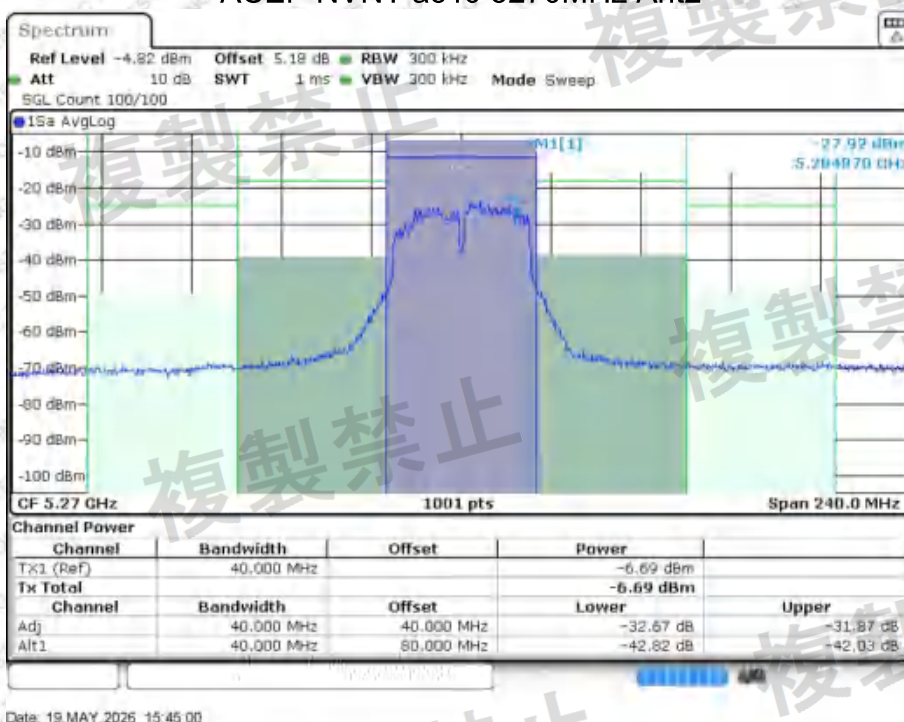




ACEP NVNT ac40 5310MHz Ant1

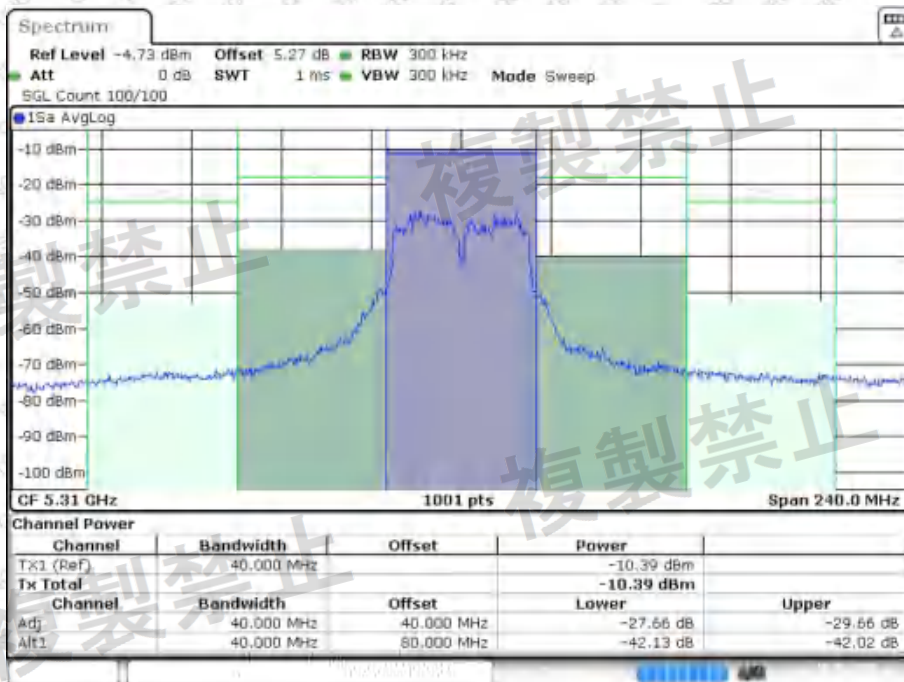

Date: 19.MAY.2025 15:49:27


ACEP NVNT ac40 5310MHz Ant2

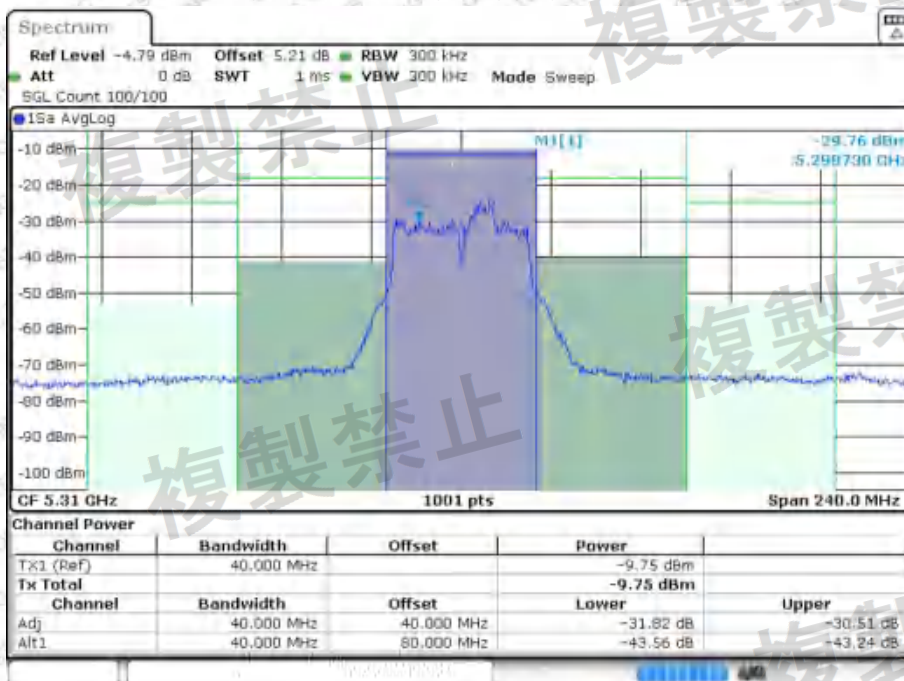

Date: 19.MAY.2025 15:49:29




ACEP NVNT ac80 5290MHz Ant1

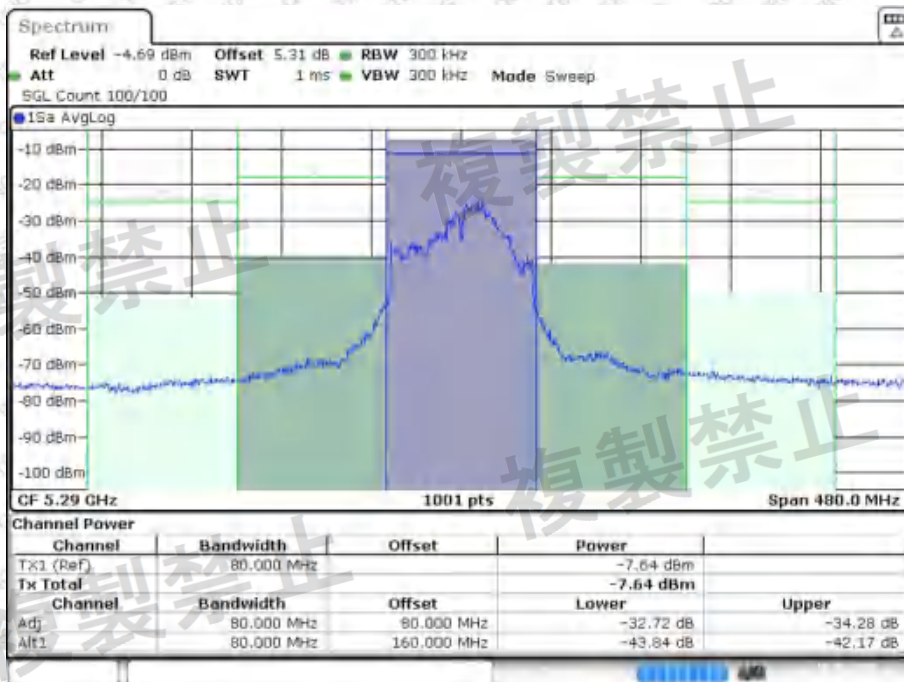

Date: 19.MAY.2025 15:53:17


ACEP NVNT ac80 5290MHz Ant2

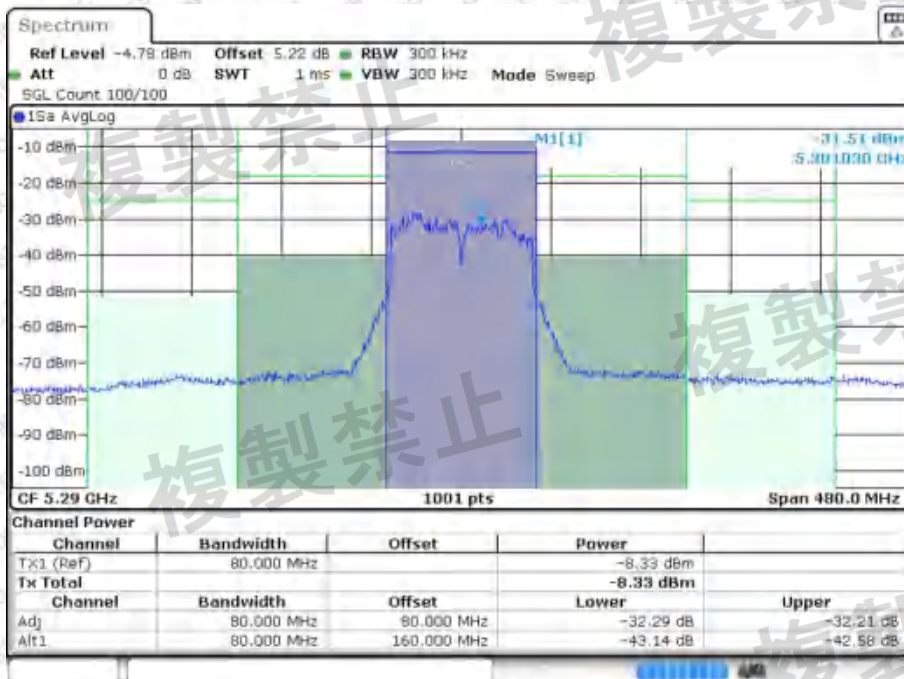

Date: 19.MAY.2025 15:53:20




ACEP NVNT ac160 5250MHz Ant1

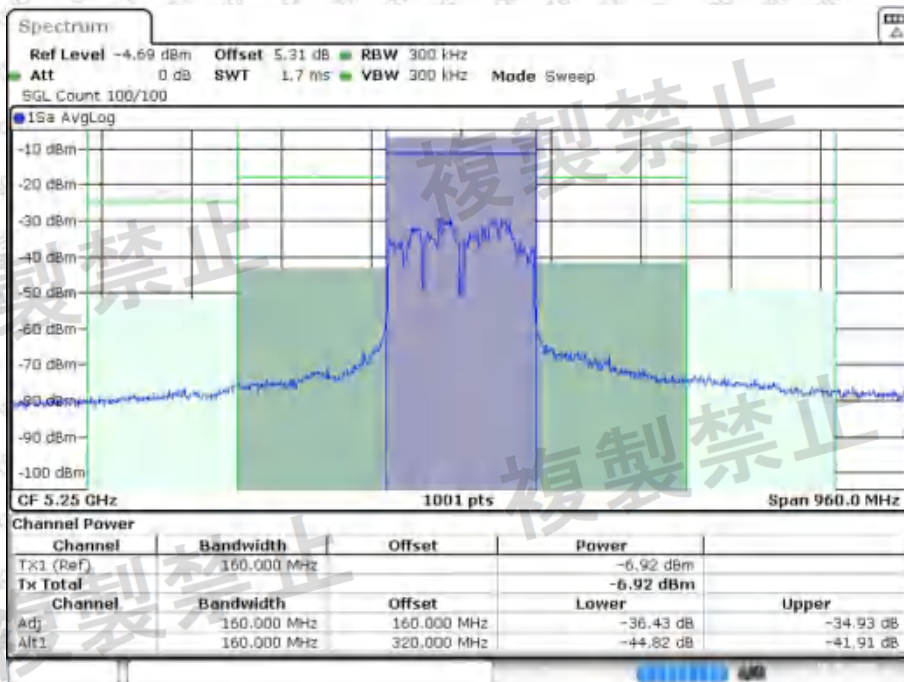

Date: 19.MAY.2025 15:56:47


ACEP NVNT ac160 5250MHz Ant2

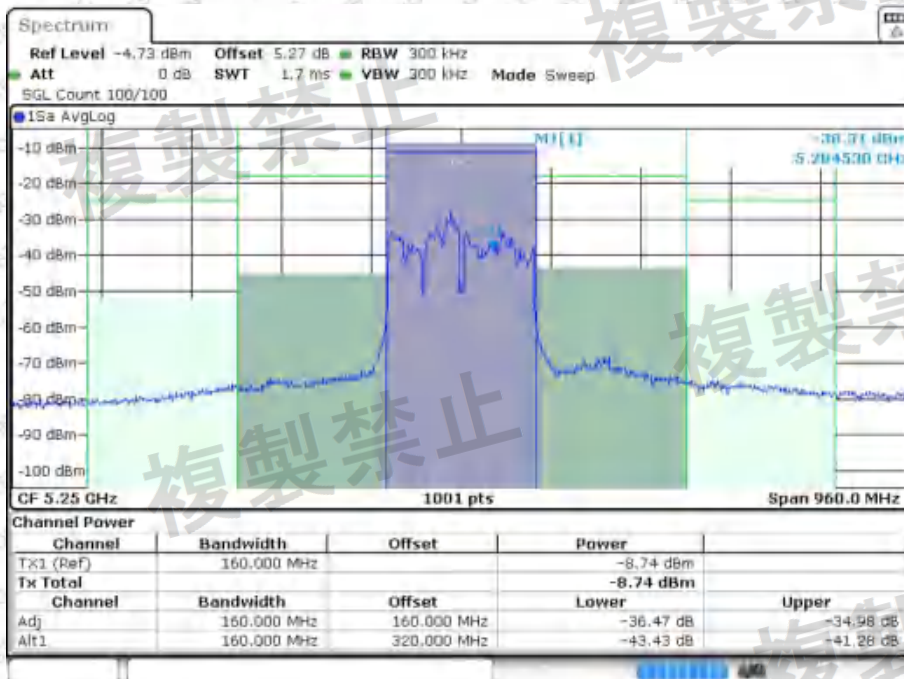

Date: 19.MAY.2025 15:56:50




ACEP NVNT ax20 5260MHz Ant1

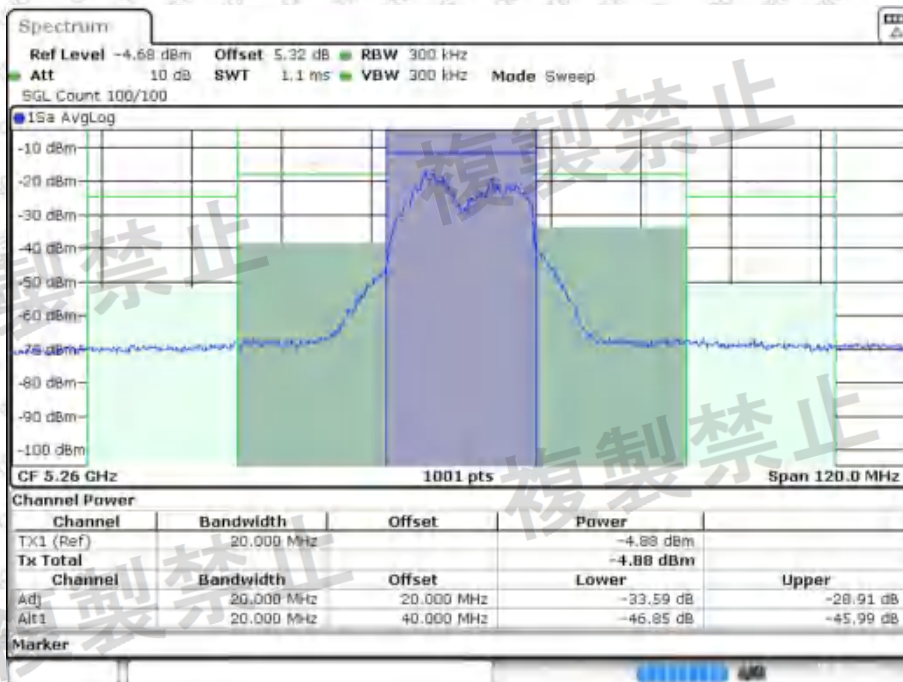

Date: 19.MAY.2025 16:04:03


ACEP NVNT ax20 5260MHz Ant2

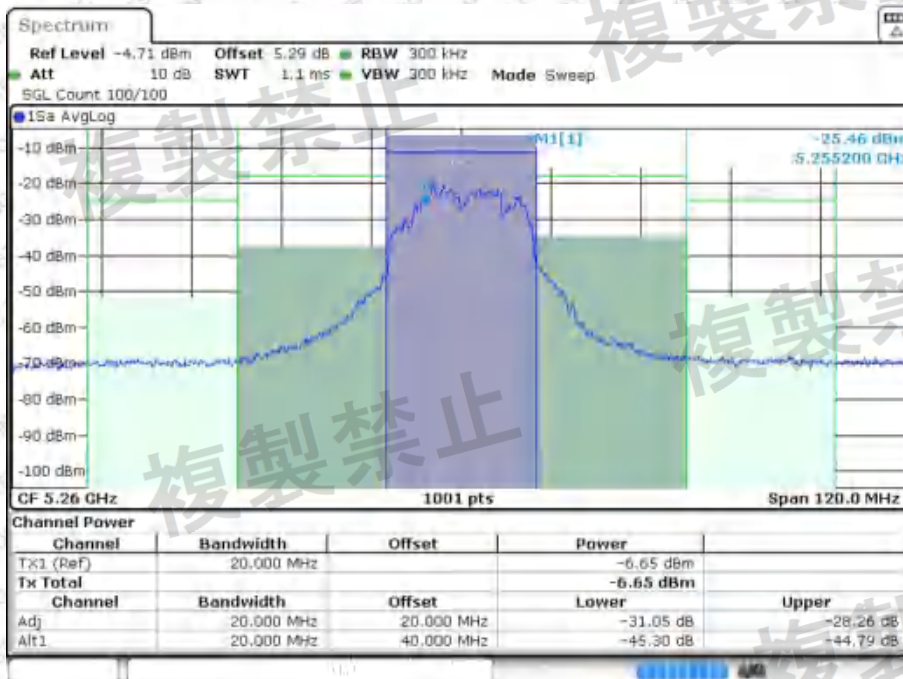

Date: 19.MAY.2025 16:04:05




ACEP NVNT ax20 5300MHz Ant1

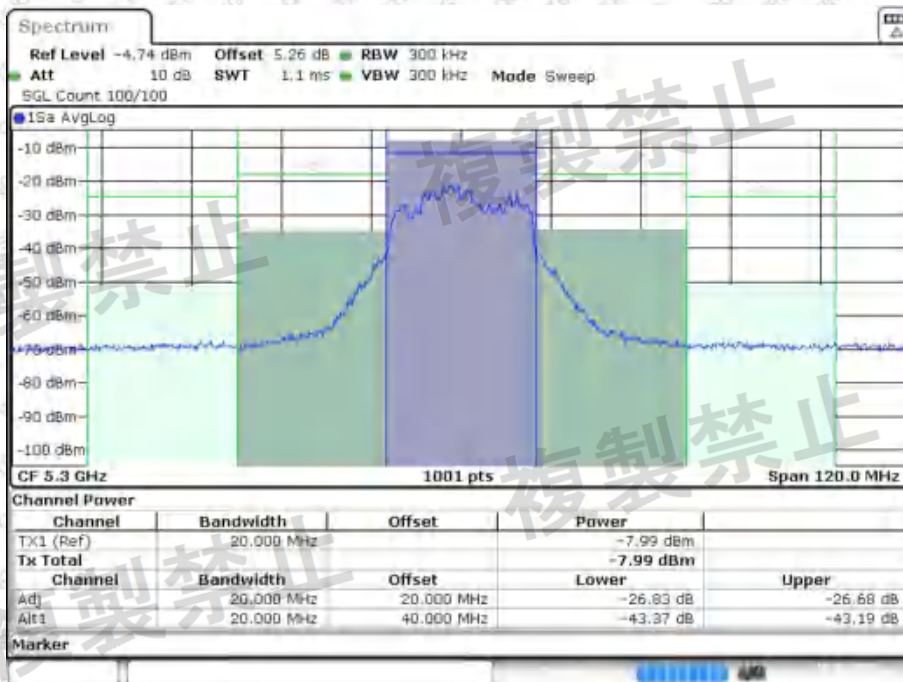

Date: 19.MAY.2025 16:07:35


ACEP NVNT ax20 5300MHz Ant2

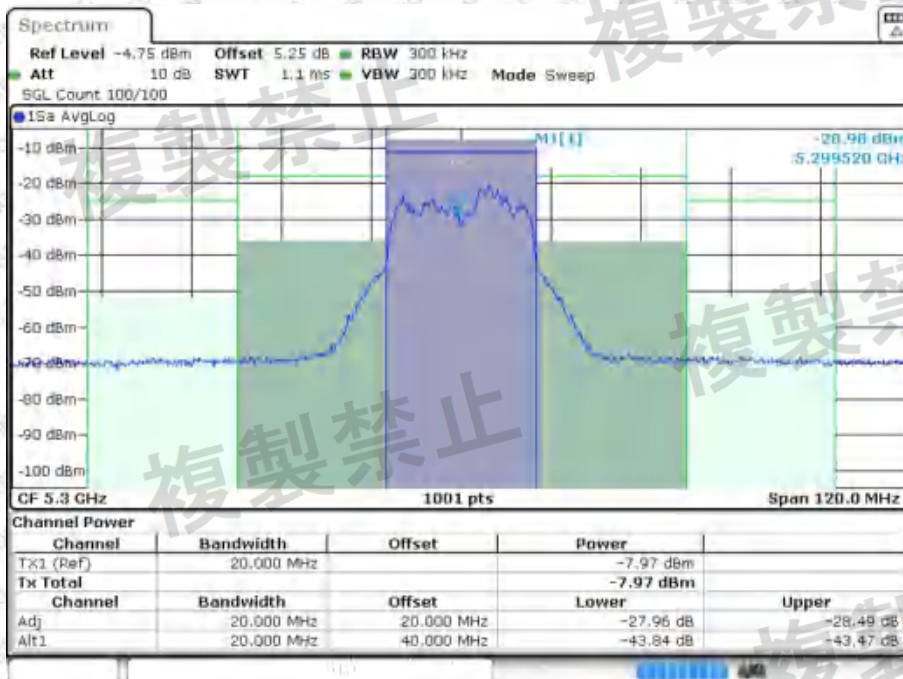

Date: 19.MAY.2025 16:07:37




ACEP NVNT ax20 5320MHz Ant1

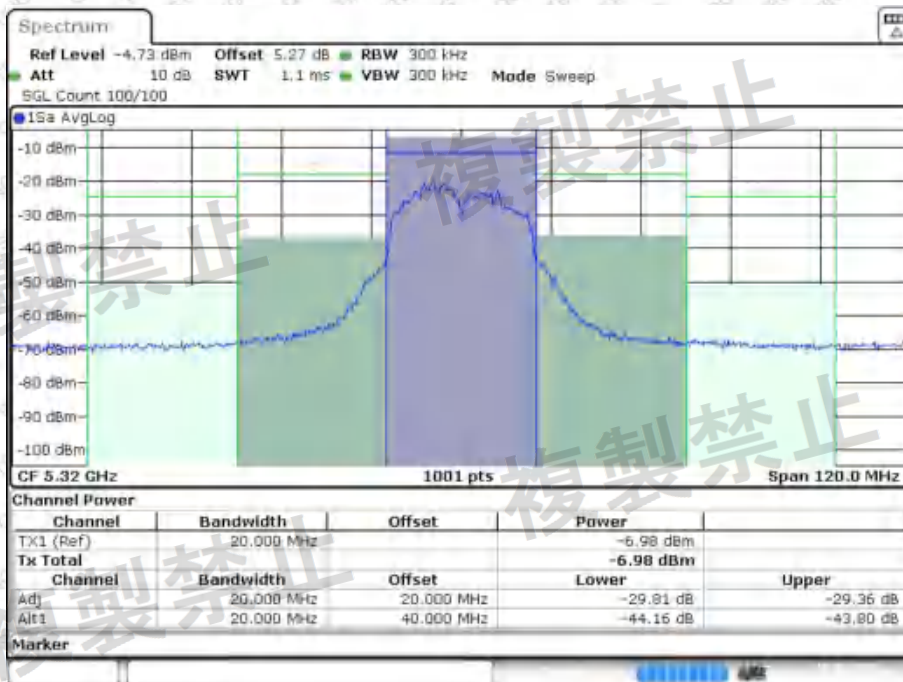

Date: 19.MAY.2025 16:10:31


ACEP NVNT ax20 5320MHz Ant2

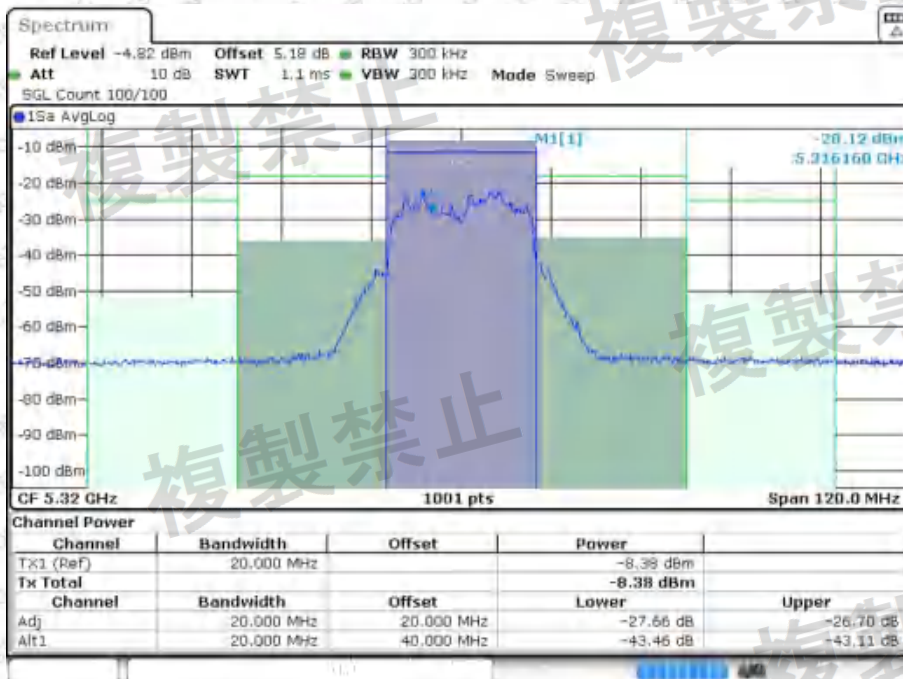

Date: 19.MAY.2025 16:10:33




ACEP NVNT ax40 5270MHz Ant1

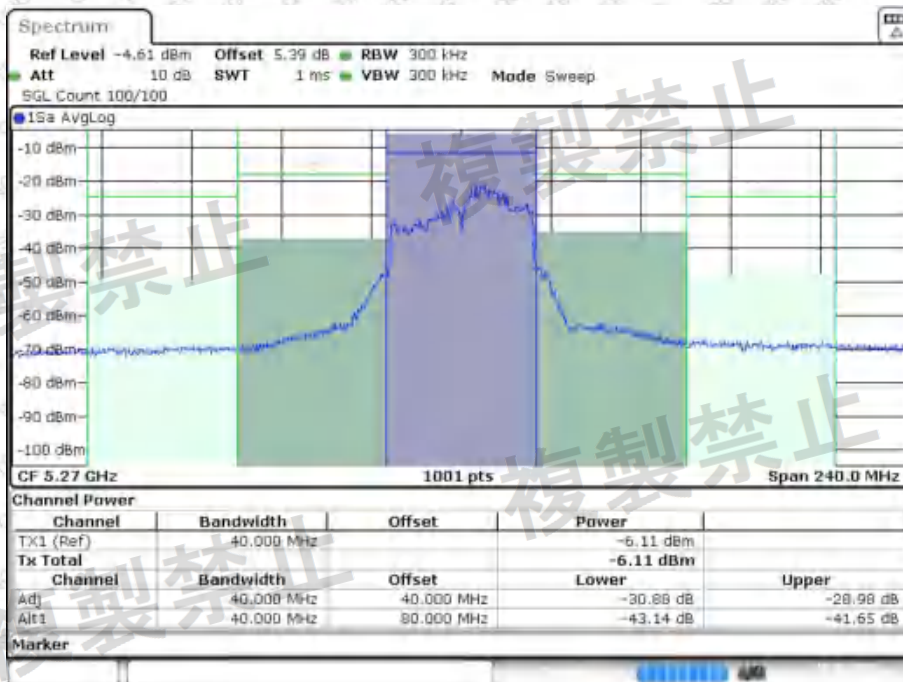

Date: 19.MAY.2025 16:15:42


ACEP NVNT ax40 5270MHz Ant2

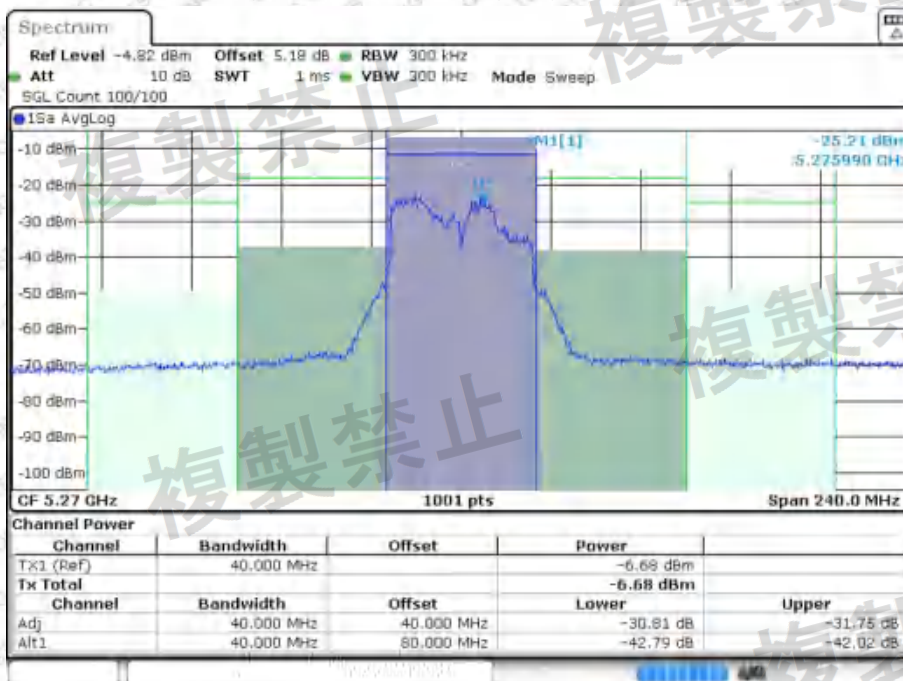


Date: 19.MAY.2025 16:15:44



ACEP NVNT ax40 5310MHz Ant1

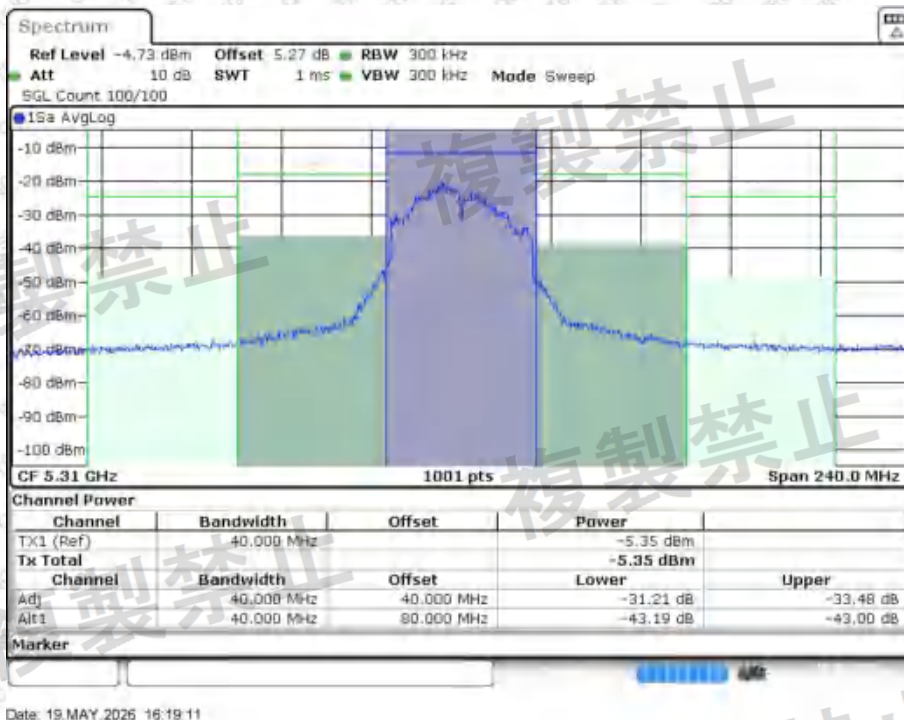


ACEP NVNT ax40 5310MHz Ant2

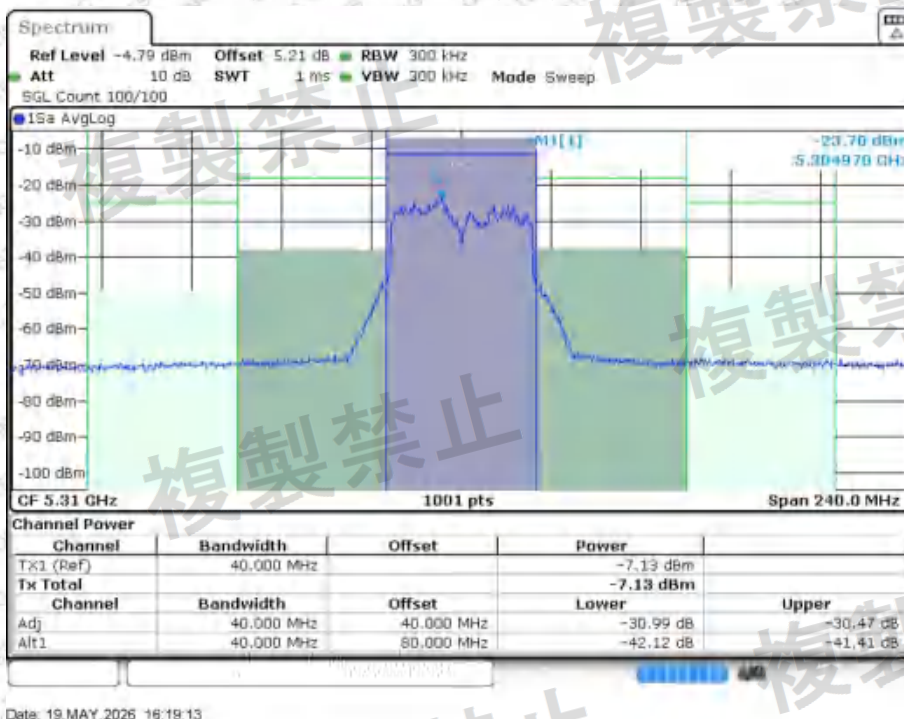




ACEP NVNT ax80 5290MHz Ant1

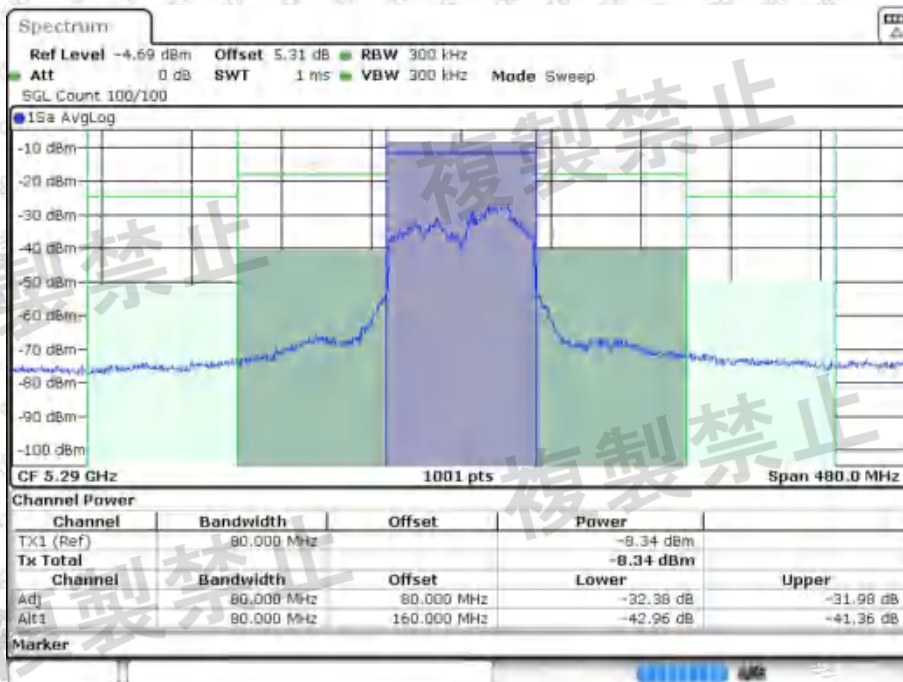

Date: 19.MAY.2025 16:22:19


ACEP NVNT ax80 5290MHz Ant2

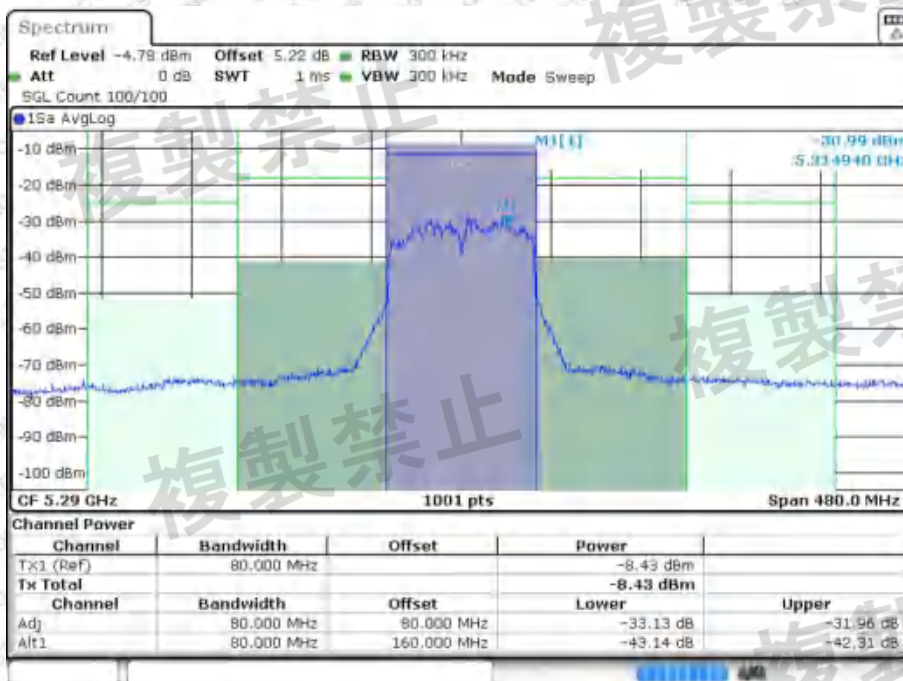

Date: 19.MAY.2025 16:22:22



ACEP NVNT ax160 5250MHz Ant1

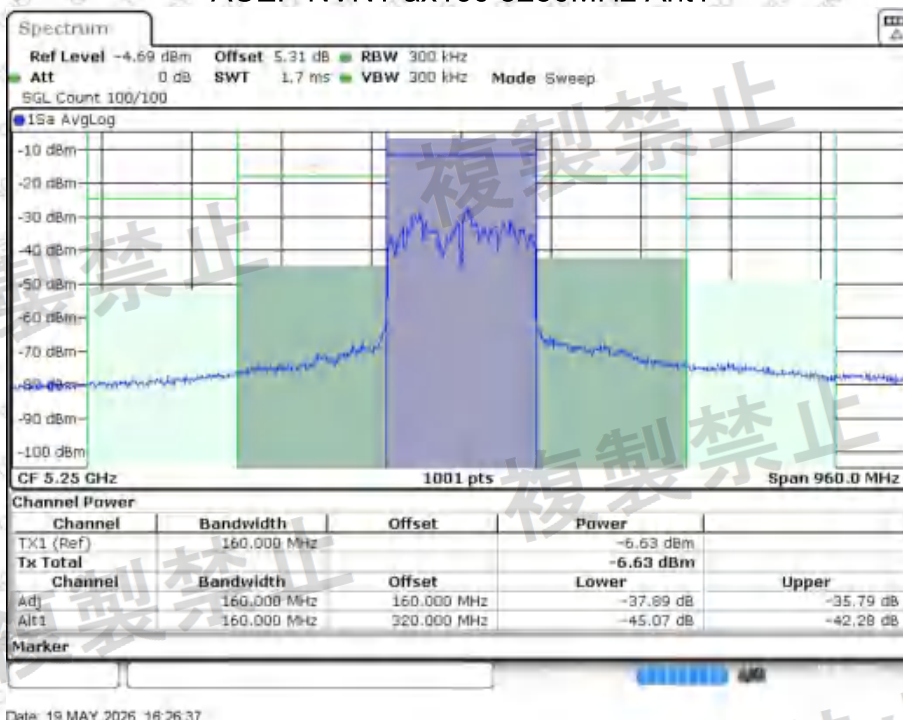

ACEP NVNT ax160 5250MHz Ant2

