






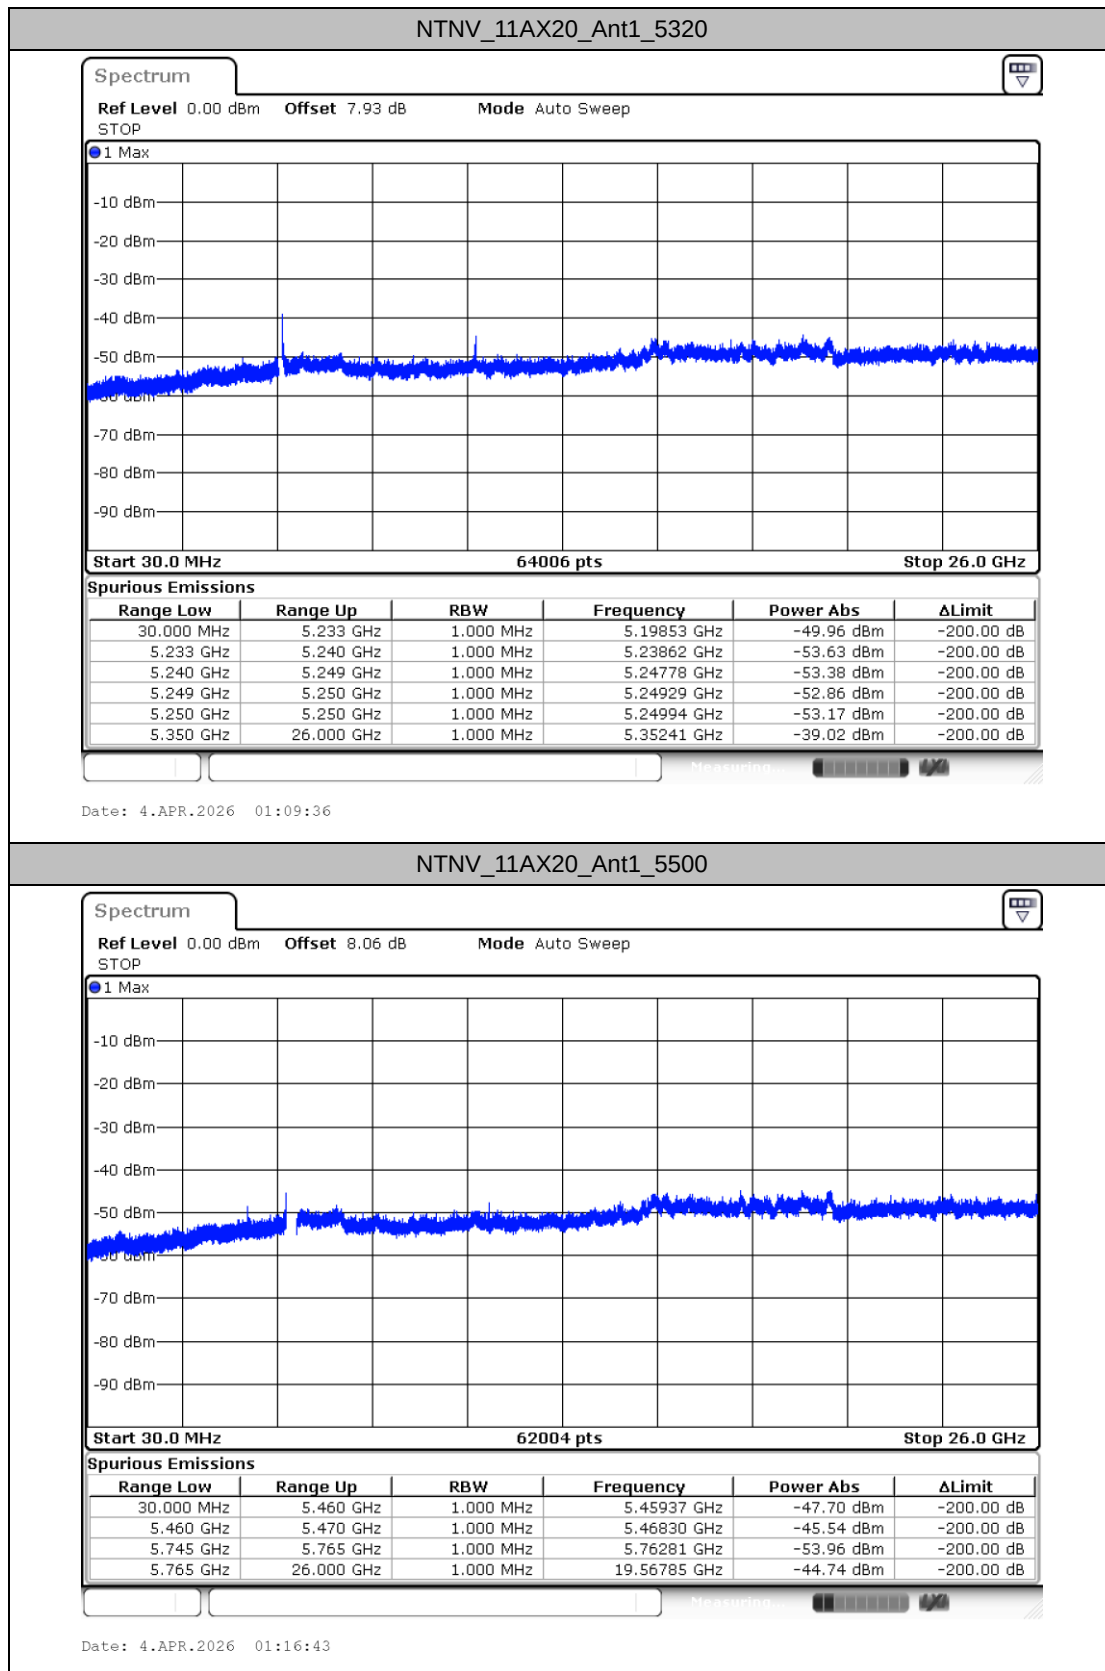


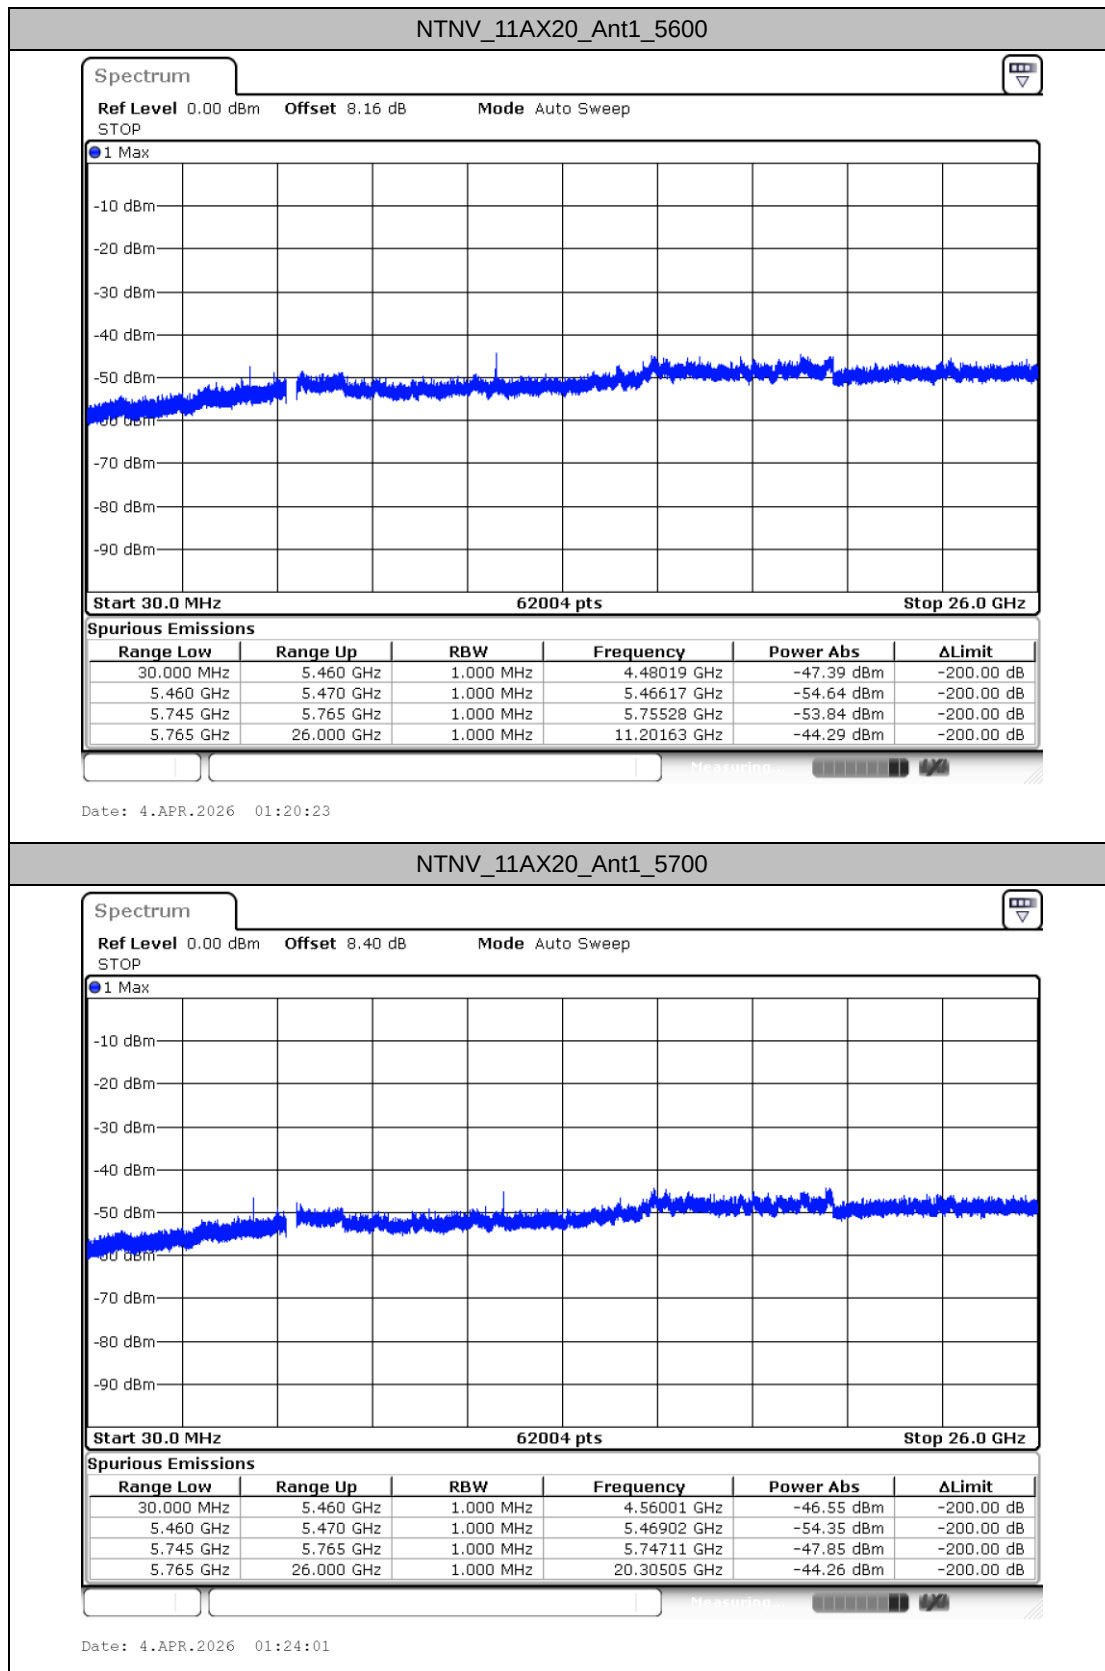


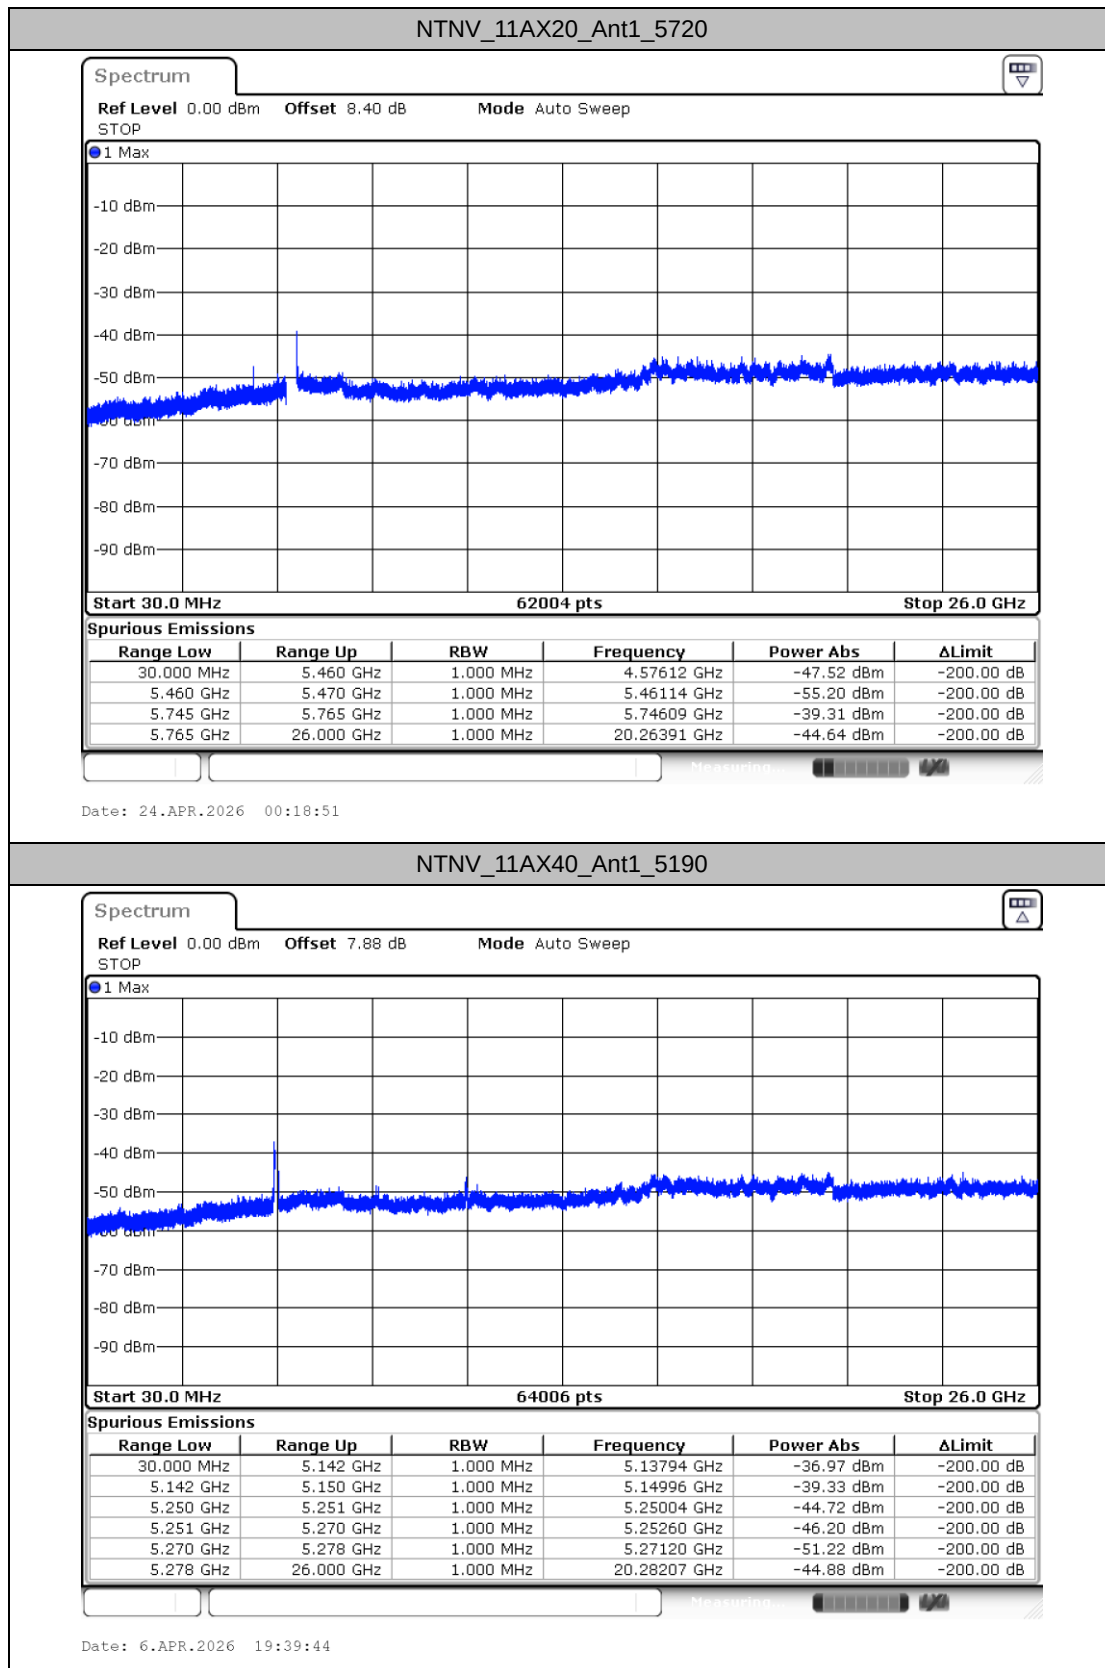


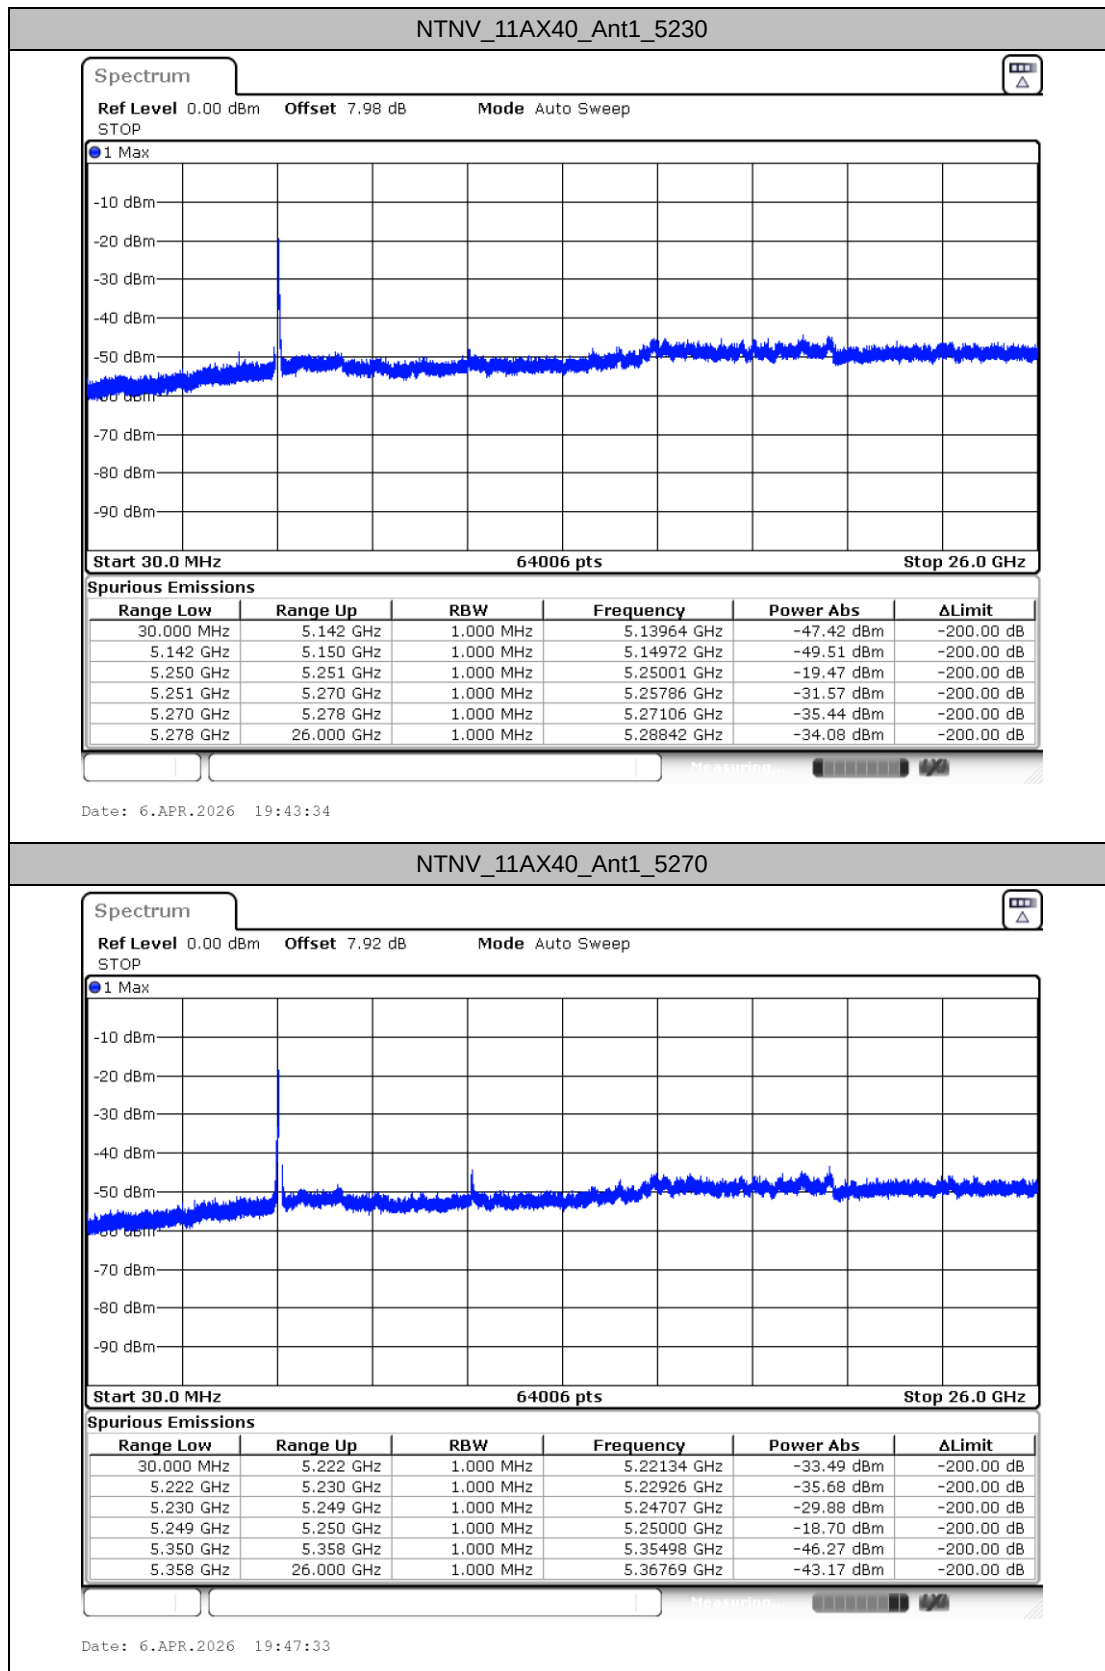


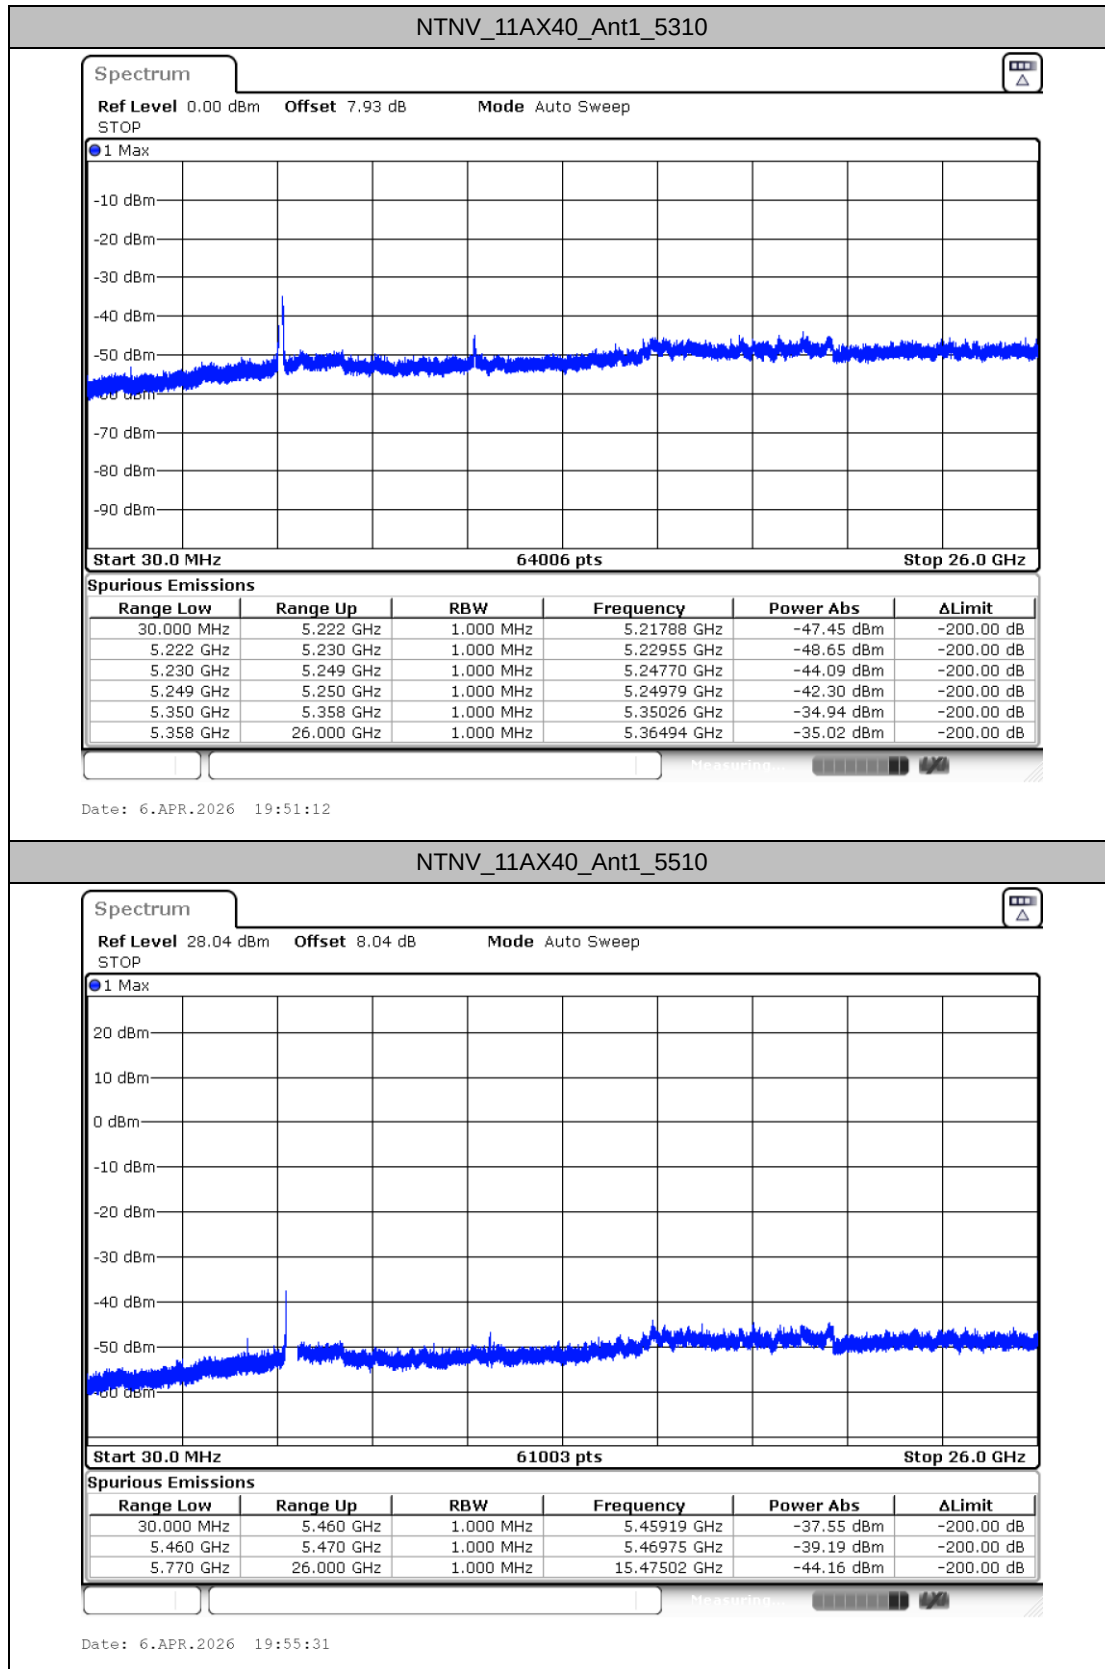

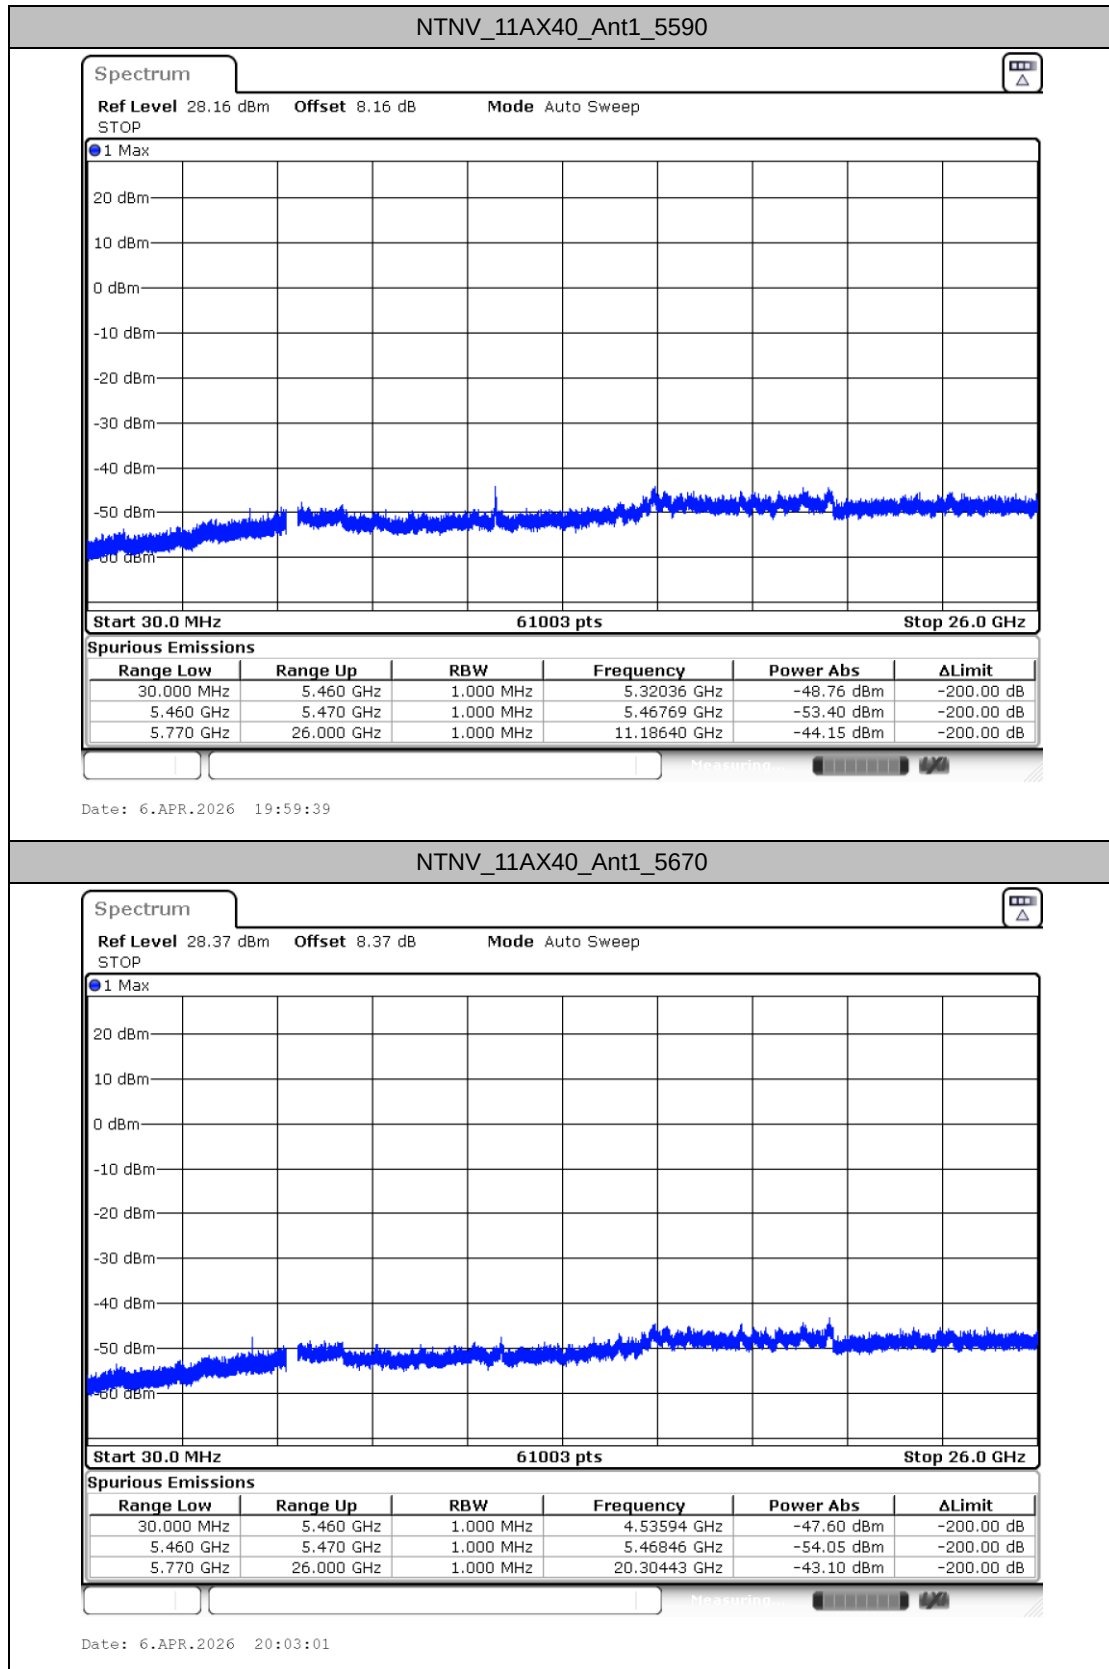

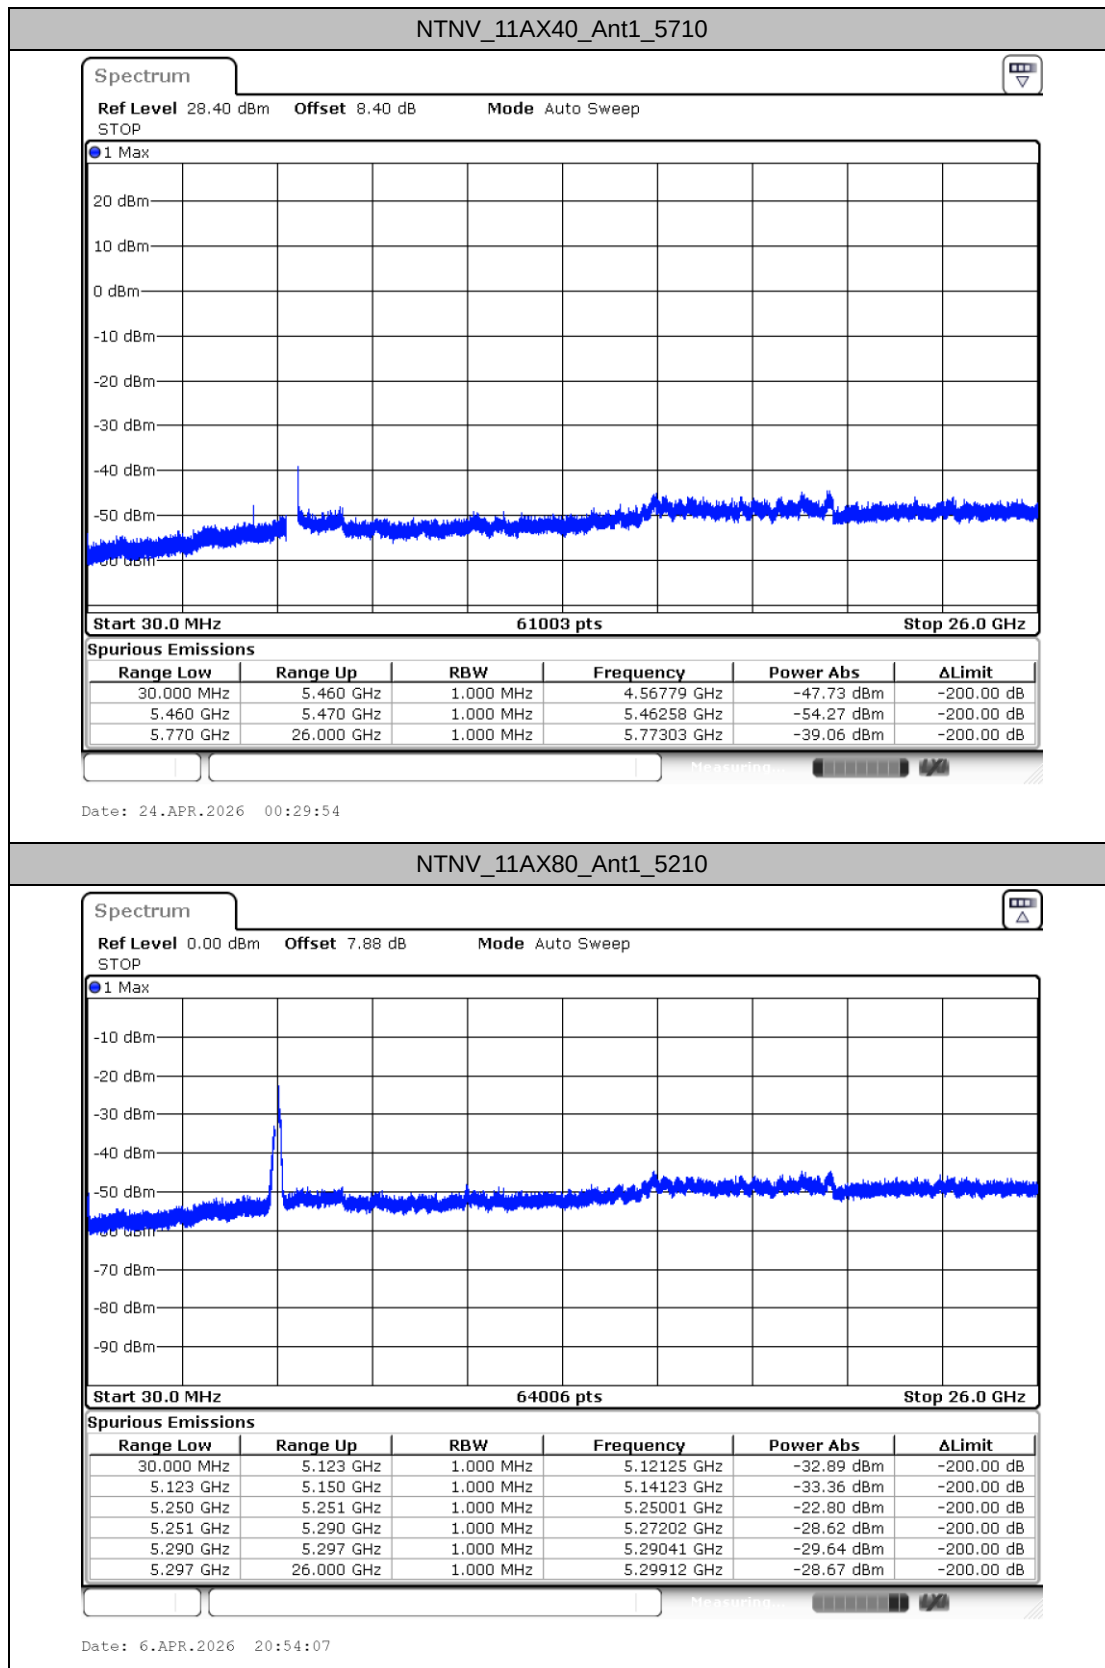

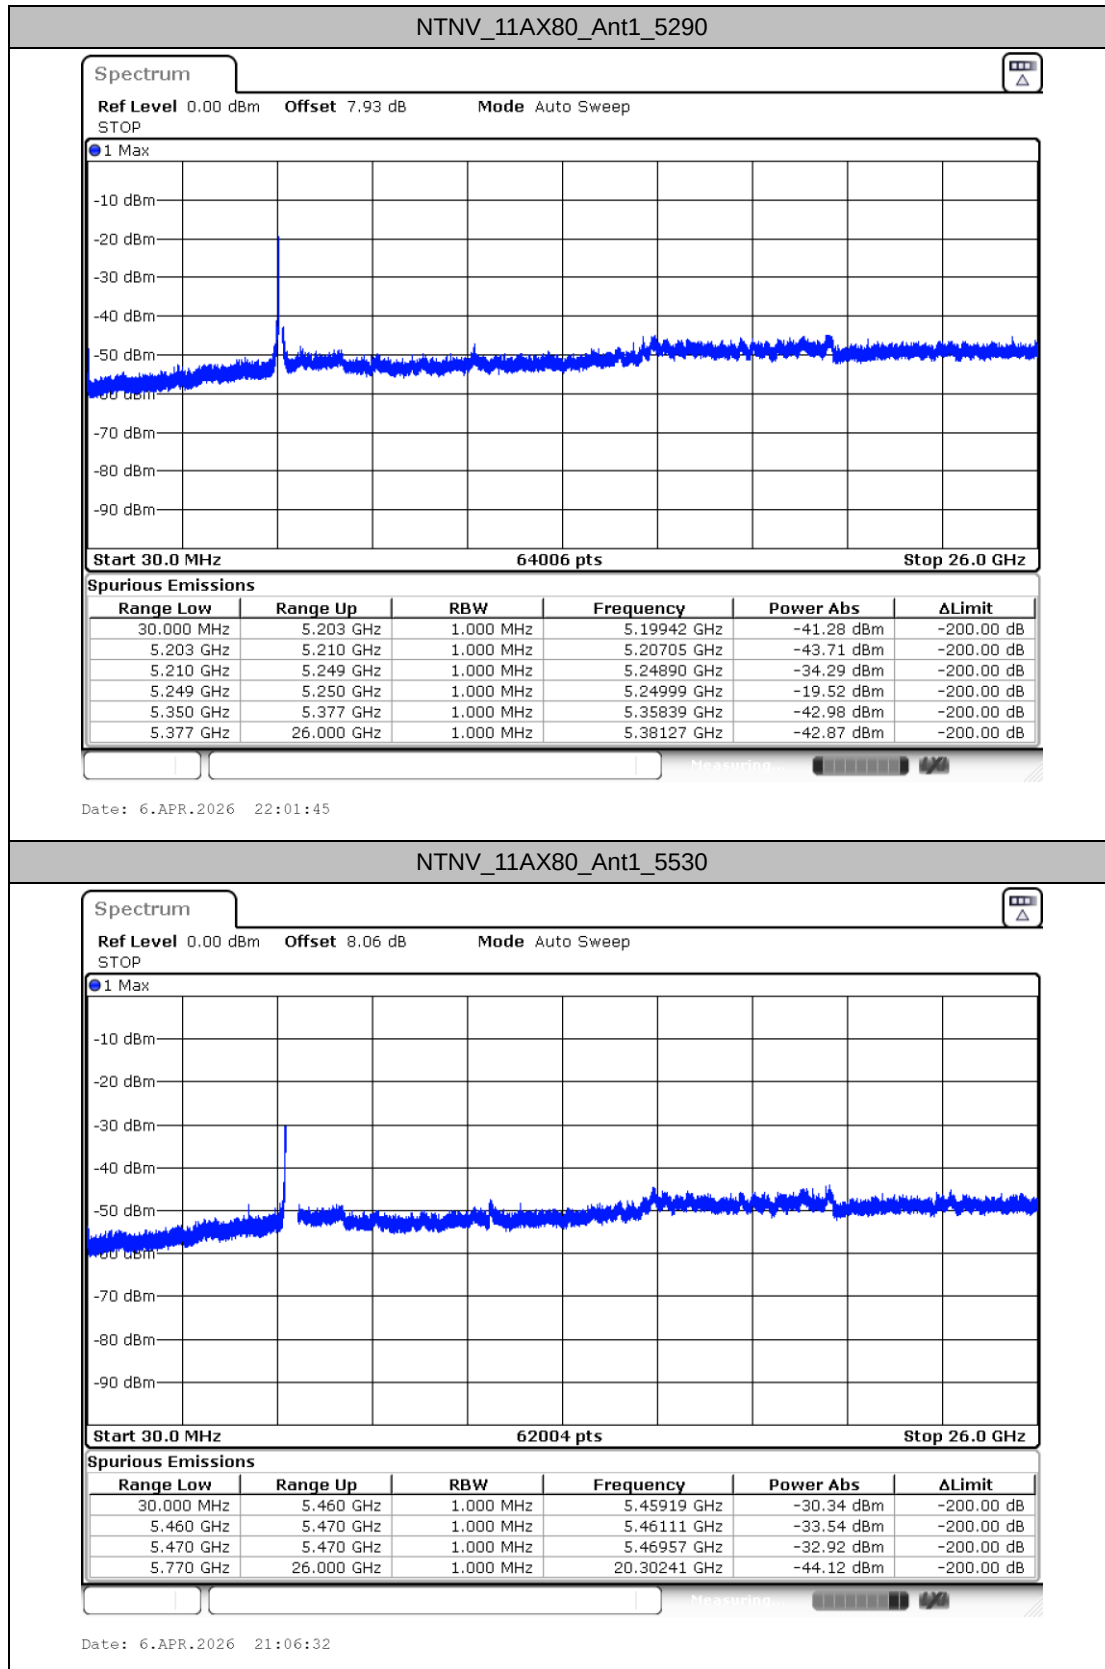

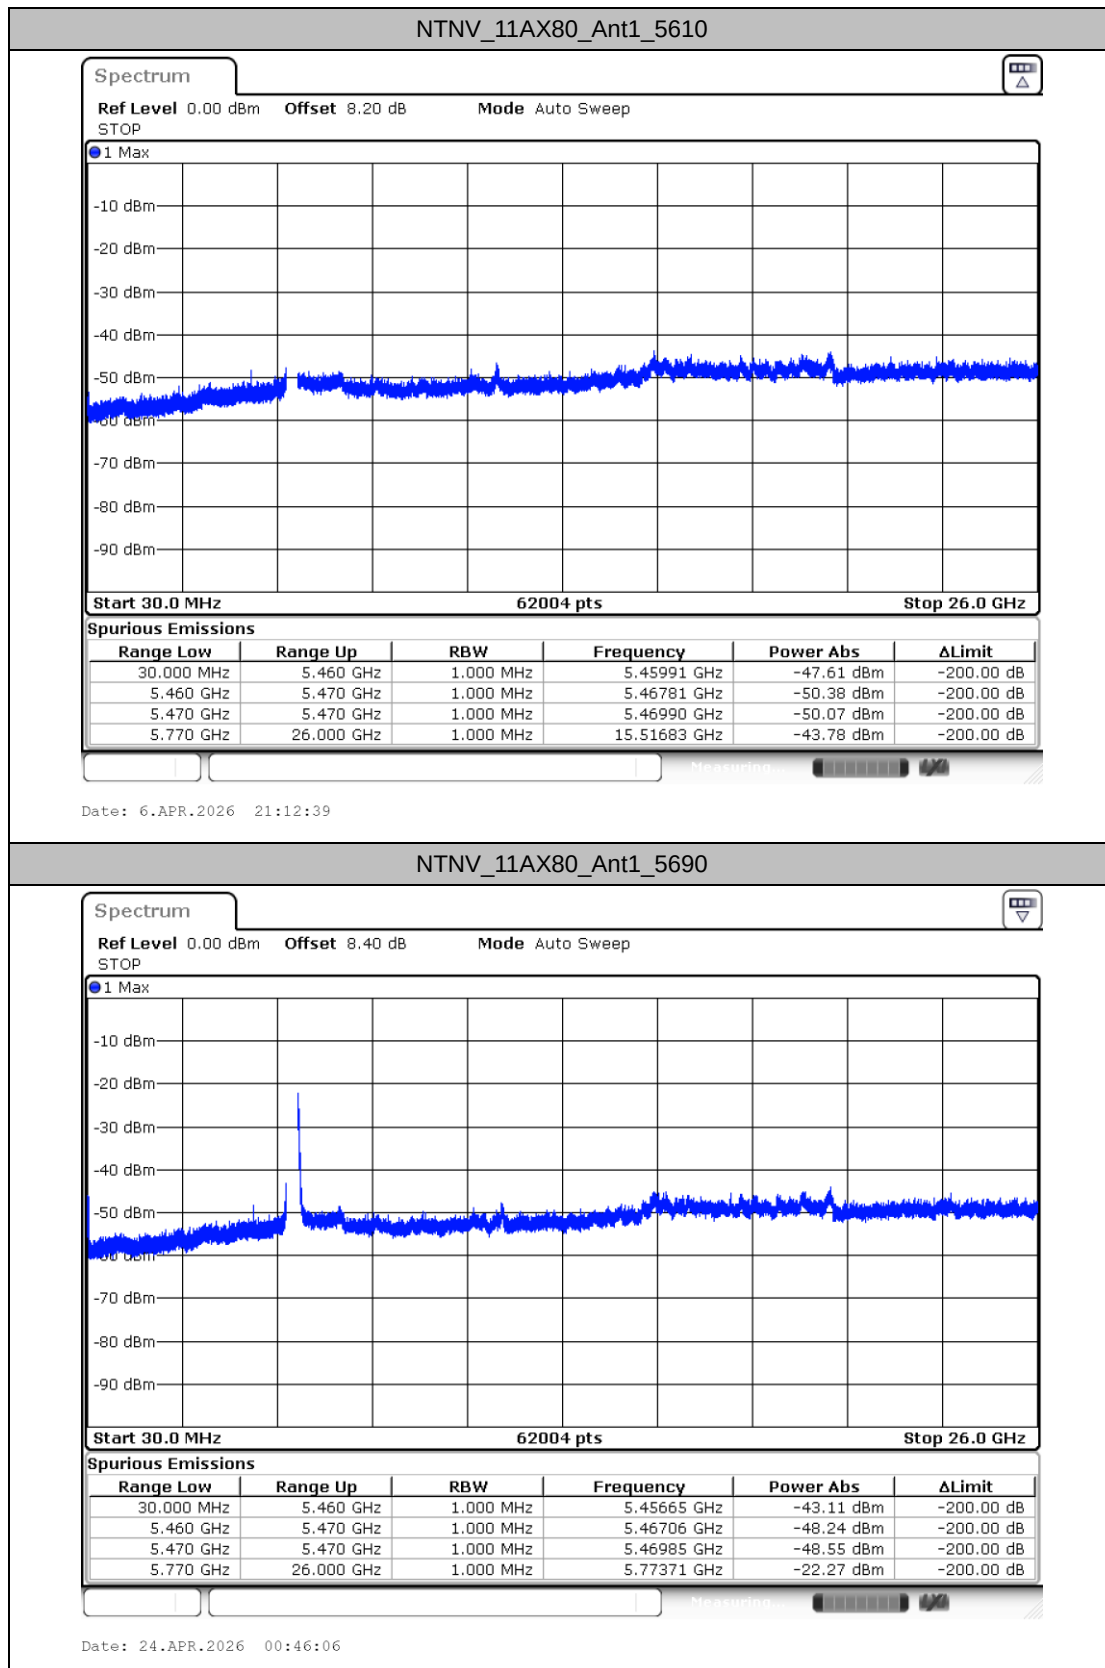

Secondarily emitted radio wave strength

Test Result

TestCondition	TestMode	Antenna	Freq(MHz)	Freq.Range [MHz]	Freq. [MHz]	Result [dBm]	Limit [dBm]	Result [nW]	Limit [nW]	Verdict
NTNV	11A	Ant1	5180	30~1000	872.16	-82.29	-54.00	0.00590	4	PASS
				1000~26000	20303.13	-66.47	-47.00	0.22542	20	PASS
			5200	30~1000	630.05	-82.28	-54.00	0.00592	4	PASS
				1000~26000	17889.38	-65.93	-47.00	0.25527	20	PASS
			5220	30~1000	913.86	-82.64	-54.00	0.00545	4	PASS
				1000~26000	15801.88	-66.40	-47.00	0.22909	20	PASS
			5240	30~1000	918.83	-81.47	-54.00	0.00713	4	PASS
				1000~26000	20258.13	-66.12	-47.00	0.24434	20	PASS
			5260	30~1000	488.33	-82.13	-54.00	0.00612	4	PASS
				1000~26000	19576.88	-66.09	-47.00	0.24604	20	PASS
			5280	30~1000	953.87	-82.39	-54.00	0.00577	4	PASS
				1000~26000	20278.13	-66.47	-47.00	0.22542	20	PASS
			5300	30~1000	639.63	-82.53	-54.00	0.00558	4	PASS
				1000~26000	20250.63	-65.81	-47.00	0.26242	20	PASS
			5320	30~1000	957.99	-81.97	-54.00	0.00635	4	PASS
				1000~26000	20305.63	-65.95	-47.00	0.25410	20	PASS
			5500	30~1000	988.42	-81.55	-54.00	0.00700	4	PASS
				1000~26000	20301.88	-66.00	-47.00	0.25119	20	PASS
			5600	30~1000	863.07	-82.19	-54.00	0.00604	4	PASS
				1000~26000	20349.38	-66.21	-47.00	0.23933	20	PASS
			5700	30~1000	737.47	-81.76	-54.00	0.00667	4	PASS
				1000~26000	20249.38	-65.03	-47.00	0.31405	20	PASS
			5720	30~1000	812.75	-82.50	-54.00	0.00562	4	PASS
				1000~26000	20294.38	-66.11	-47.00	0.24491	20	PASS
	11N20	Ant1	5180	30~1000	945.63	-82.45	-54.00	0.00569	4	PASS
				1000~26000	20276.88	-65.55	-47.00	0.27861	20	PASS
			5200	30~1000	970.48	-82.74	-54.00	0.00532	4	PASS
				1000~26000	20310.63	-66.13	-47.00	0.24378	20	PASS
			5220	30~1000	882.46	-83.35	-54.00	0.00462	4	PASS
				1000~26000	20298.13	-66.02	-47.00	0.25003	20	PASS
			5240	30~1000	933.99	-82.61	-54.00	0.00548	4	PASS
				1000~26000	19578.13	-66.12	-47.00	0.24434	20	PASS
			5260	30~1000	974.12	-81.61	-54.00	0.00690	4	PASS

	11N40	Ant1		1000~26000	20276.88	-66.18	-47.00	0.24099	20	PASS
			5280	30~1000	970.96	-81.90	-54.00	0.00646	4	PASS
				1000~26000	20318.13	-66.24	-47.00	0.23768	20	PASS
			5300	30~1000	376.91	-82.65	-54.00	0.00543	4	PASS
				1000~26000	17868.13	-66.08	-47.00	0.24660	20	PASS
			5320	30~1000	830.70	-82.36	-54.00	0.00581	4	PASS
				1000~26000	20325.63	-66.37	-47.00	0.23067	20	PASS
			5500	30~1000	746.80	-82.30	-54.00	0.00589	4	PASS
				1000~26000	20293.13	-65.70	-47.00	0.26915	20	PASS
			5600	30~1000	977.39	-82.02	-54.00	0.00628	4	PASS
				1000~26000	20294.38	-66.18	-47.00	0.24099	20	PASS
			5700	30~1000	816.39	-82.22	-54.00	0.00600	4	PASS
				1000~26000	19561.88	-65.80	-47.00	0.26303	20	PASS
			5720	30~1000	874.83	-82.00	-54.00	0.00631	4	PASS
				1000~26000	20288.13	-65.74	-47.00	0.26669	20	PASS
	11AC20	Ant1	5190	30~1000	902.35	-82.48	-54.00	0.00565	4	PASS
				1000~26000	20263.13	-66.45	-47.00	0.22646	20	PASS
			5230	30~1000	939.32	-81.95	-54.00	0.00638	4	PASS
				1000~26000	20303.13	-65.81	-47.00	0.26242	20	PASS
			5270	30~1000	949.14	-82.44	-54.00	0.00570	4	PASS
				1000~26000	20305.63	-65.89	-47.00	0.25763	20	PASS
			5310	30~1000	989.03	-82.82	-54.00	0.00522	4	PASS
				1000~26000	20286.88	-66.13	-47.00	0.24378	20	PASS
			5510	30~1000	959.93	-82.50	-54.00	0.00562	4	PASS
				1000~26000	18225.63	-66.13	-47.00	0.24378	20	PASS
			5590	30~1000	838.82	-81.67	-54.00	0.00681	4	PASS
				1000~26000	15473.13	-66.05	-47.00	0.24831	20	PASS
			5670	30~1000	996.79	-82.34	-54.00	0.00583	4	PASS
				1000~26000	19570.63	-65.87	-47.00	0.25882	20	PASS
			5710	30~1000	983.69	-81.06	-54.00	0.00783	4	PASS
				1000~26000	20261.88	-66.03	-47.00	0.24946	20	PASS
	11AC20	Ant1	5180	30~1000	919.92	-82.75	-54.00	0.00531	4	PASS
				1000~26000	20273.13	-66.42	-47.00	0.22803	20	PASS
			5200	30~1000	999.58	-83.39	-54.00	0.00458	4	PASS
				1000~26000	20294.38	-66.75	-47.00	0.21135	20	PASS
			5220	30~1000	791.54	-83.30	-54.00	0.00468	4	PASS
				1000~26000	20311.88	-66.43	-47.00	0.22751	20	PASS
			5240	30~1000	967.08	-82.78	-54.00	0.00527	4	PASS
				1000~26000	20295.63	-67.07	-47.00	0.19634	20	PASS



	11AC40	Ant1	5260	30~1000	937.26	-83.03	-54.00	0.00498	4	PASS
				1000~26000	20306.88	-66.86	-47.00	0.20606	20	PASS
			5280	30~1000	940.90	-82.85	-54.00	0.00519	4	PASS
				1000~26000	18233.13	-66.86	-47.00	0.20606	20	PASS
			5300	30~1000	905.86	-82.98	-54.00	0.00504	4	PASS
				1000~26000	20319.38	-67.04	-47.00	0.19770	20	PASS
			5320	30~1000	822.57	-82.87	-54.00	0.00516	4	PASS
				1000~26000	20293.13	-66.02	-47.00	0.25003	20	PASS
			5500	30~1000	607.87	-83.21	-54.00	0.00478	4	PASS
				1000~26000	20296.88	-66.74	-47.00	0.21184	20	PASS
			5600	30~1000	829.97	-82.57	-54.00	0.00553	4	PASS
				1000~26000	19575.63	-66.72	-47.00	0.21281	20	PASS
			5700	30~1000	926.35	-82.45	-54.00	0.00569	4	PASS
				1000~26000	15830.63	-66.68	-47.00	0.21478	20	PASS
	11AC80	Ant1	5190	30~1000	941.38	-83.62	-54.00	0.00435	4	PASS
				1000~26000	15523.13	-67.26	-47.00	0.18793	20	PASS
			5230	30~1000	797.84	-83.59	-54.00	0.00438	4	PASS
				1000~26000	15460.63	-66.63	-47.00	0.21727	20	PASS
			5270	30~1000	937.50	-82.83	-54.00	0.00521	4	PASS
				1000~26000	20330.63	-67.03	-47.00	0.19815	20	PASS
			5310	30~1000	925.99	-82.95	-54.00	0.00507	4	PASS
				1000~26000	20254.38	-66.67	-47.00	0.21528	20	PASS
			5510	30~1000	932.53	-82.55	-54.00	0.00556	4	PASS
				1000~26000	18241.88	-66.71	-47.00	0.21330	20	PASS
			5590	30~1000	986.36	-82.74	-54.00	0.00532	4	PASS
				1000~26000	20281.88	-66.23	-47.00	0.23823	20	PASS
			5670	30~1000	905.25	-82.33	-54.00	0.00585	4	PASS
				1000~26000	20263.13	-66.51	-47.00	0.22336	20	PASS
	11AX20	Ant1	5210	30~1000	743.89	-81.84	-54.00	0.00655	4	PASS
				1000~26000	20309.38	-64.87	-47.00	0.32584	20	PASS
			5290	30~1000	871.67	-81.84	-54.00	0.00655	4	PASS
				1000~26000	20289.38	-66.24	-47.00	0.23768	20	PASS
			5530	30~1000	953.26	-82.27	-54.00	0.00593	4	PASS
				1000~26000	20329.38	-66.01	-47.00	0.25061	20	PASS
			5610	30~1000	883.07	-82.56	-54.00	0.00555	4	PASS
				1000~26000	20308.13	-66.34	-47.00	0.23227	20	PASS
			5690	30~1000	955.93	-81.82	-54.00	0.00658	4	PASS
				1000~26000	20305.63	-65.51	-47.00	0.28119	20	PASS
	11AX20	Ant1	5180	30~1000	983.69	-81.79	-54.00	0.00662	4	PASS





				1000~26000	20306.88	-66.22	-47.00	0.23878	20	PASS
				30~1000	971.81	-82.76	-54.00	0.00530	4	PASS
				1000~26000	20325.63	-66.19	-47.00	0.24044	20	PASS
				30~1000	870.58	-82.83	-54.00	0.00521	4	PASS
				1000~26000	15520.63	-66.12	-47.00	0.24434	20	PASS
				30~1000	914.47	-82.30	-54.00	0.00589	4	PASS
				1000~26000	20299.38	-66.31	-47.00	0.23388	20	PASS
				30~1000	978.60	-82.36	-54.00	0.00581	4	PASS
				1000~26000	20300.63	-65.12	-47.00	0.30761	20	PASS
				30~1000	925.38	-82.33	-54.00	0.00585	4	PASS
				1000~26000	20291.88	-66.31	-47.00	0.23388	20	PASS
				30~1000	806.81	-82.57	-54.00	0.00553	4	PASS
				1000~26000	15883.13	-66.28	-47.00	0.23550	20	PASS
				30~1000	856.52	-82.23	-54.00	0.00598	4	PASS
				1000~26000	20326.88	-65.54	-47.00	0.27925	20	PASS
				30~1000	947.44	-82.25	-54.00	0.00596	4	PASS
				1000~26000	20279.38	-65.76	-47.00	0.26546	20	PASS
				30~1000	993.64	-82.39	-54.00	0.00577	4	PASS
				1000~26000	20293.13	-66.08	-47.00	0.24660	20	PASS
				30~1000	956.17	-81.28	-54.00	0.00745	4	PASS
				1000~26000	20275.63	-65.74	-47.00	0.26669	20	PASS
				30~1000	958.48	-82.01	-54.00	0.00630	4	PASS
				1000~26000	20330.63	-65.39	-47.00	0.28907	20	PASS
	11AX40	Ant1	5190	30~1000	901.50	-83.07	-54.00	0.00493	4	PASS
				1000~26000	20299.38	-66.03	-47.00	0.24946	20	PASS
			5230	30~1000	960.78	-82.64	-54.00	0.00545	4	PASS
				1000~26000	20261.88	-65.49	-47.00	0.28249	20	PASS
			5270	30~1000	949.51	-82.43	-54.00	0.00571	4	PASS
				1000~26000	1959.38	-63.69	-47.00	0.42756	20	PASS
			5310	30~1000	926.23	-82.09	-54.00	0.00618	4	PASS
				1000~26000	20285.63	-66.19	-47.00	0.24044	20	PASS
			5510	30~1000	563.98	-82.56	-54.00	0.00555	4	PASS
				1000~26000	19579.38	-66.29	-47.00	0.23496	20	PASS
			5590	30~1000	939.44	-82.17	-54.00	0.00607	4	PASS
				1000~26000	20331.88	-65.57	-47.00	0.27733	20	PASS
			5670	30~1000	835.54	-80.77	-54.00	0.00838	4	PASS
				1000~26000	20275.63	-65.96	-47.00	0.25351	20	PASS
			5710	30~1000	933.62	-81.29	-54.00	0.00743	4	PASS
				1000~26000	19596.88	-65.73	-47.00	0.26730	20	PASS





	11AX80	Ant1	5210	30~1000	964.18	-82.50	-54.00	0.00562	4	PASS
				1000~26000	20359.38	-66.08	-47.00	0.24660	20	PASS
			5290	30~1000	578.16	-82.31	-54.00	0.00587	4	PASS
				1000~26000	20331.88	-65.93	-47.00	0.25527	20	PASS
			5530	30~1000	963.33	-82.46	-54.00	0.00568	4	PASS
				1000~26000	19576.88	-66.06	-47.00	0.24774	20	PASS
			5610	30~1000	969.63	-82.62	-54.00	0.00547	4	PASS
				1000~26000	20288.13	-65.77	-47.00	0.26485	20	PASS
			5690	30~1000	906.10	-82.33	-54.00	0.00585	4	PASS
				1000~26000	20266.88	-65.75	-47.00	0.26607	20	PASS


Test Graphs

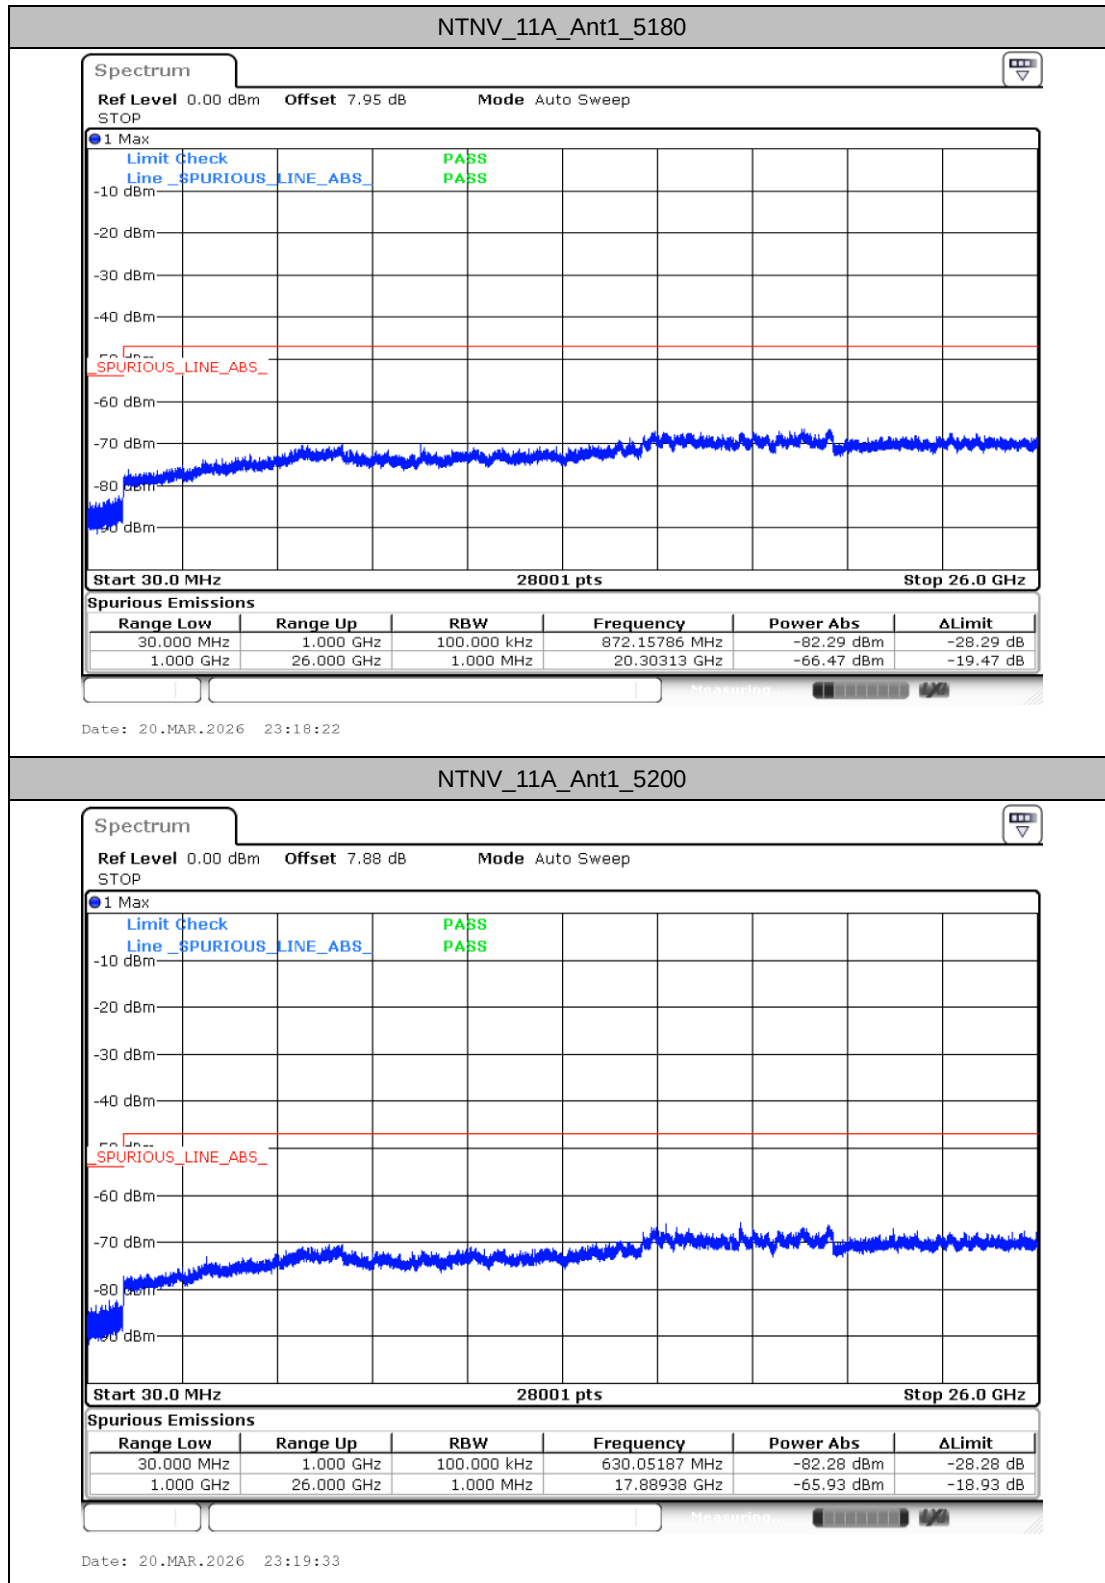


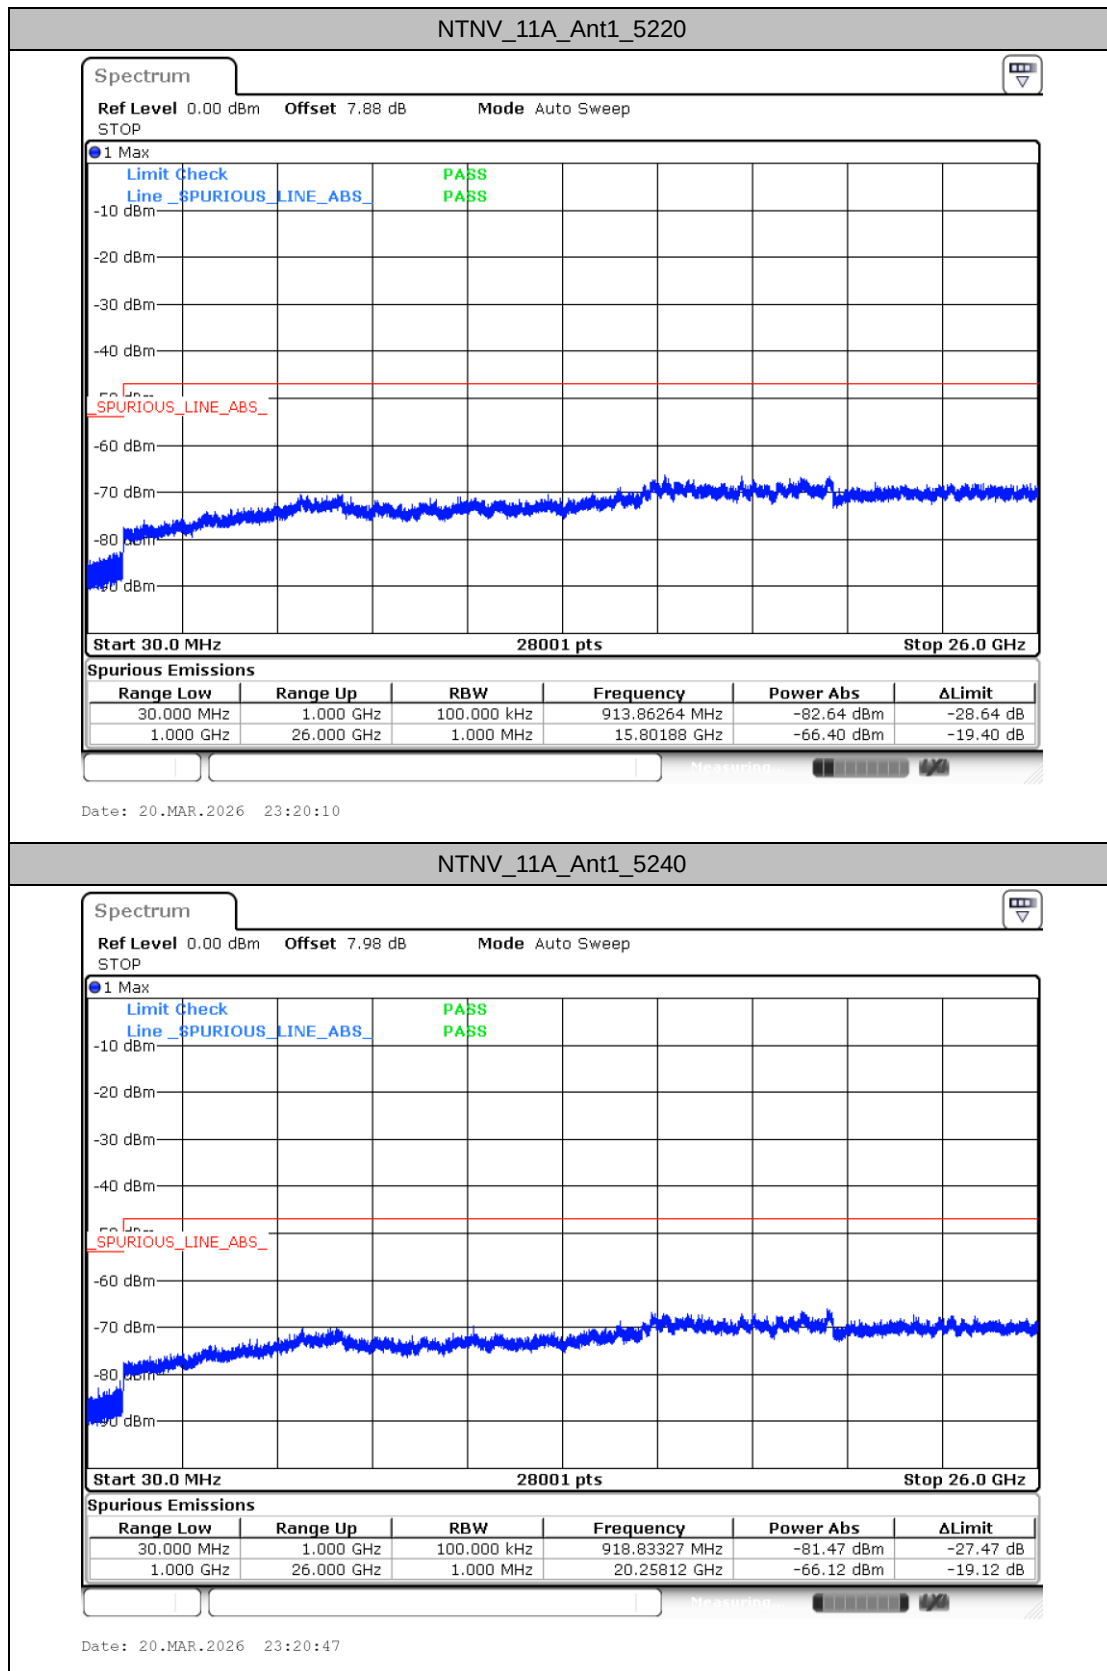


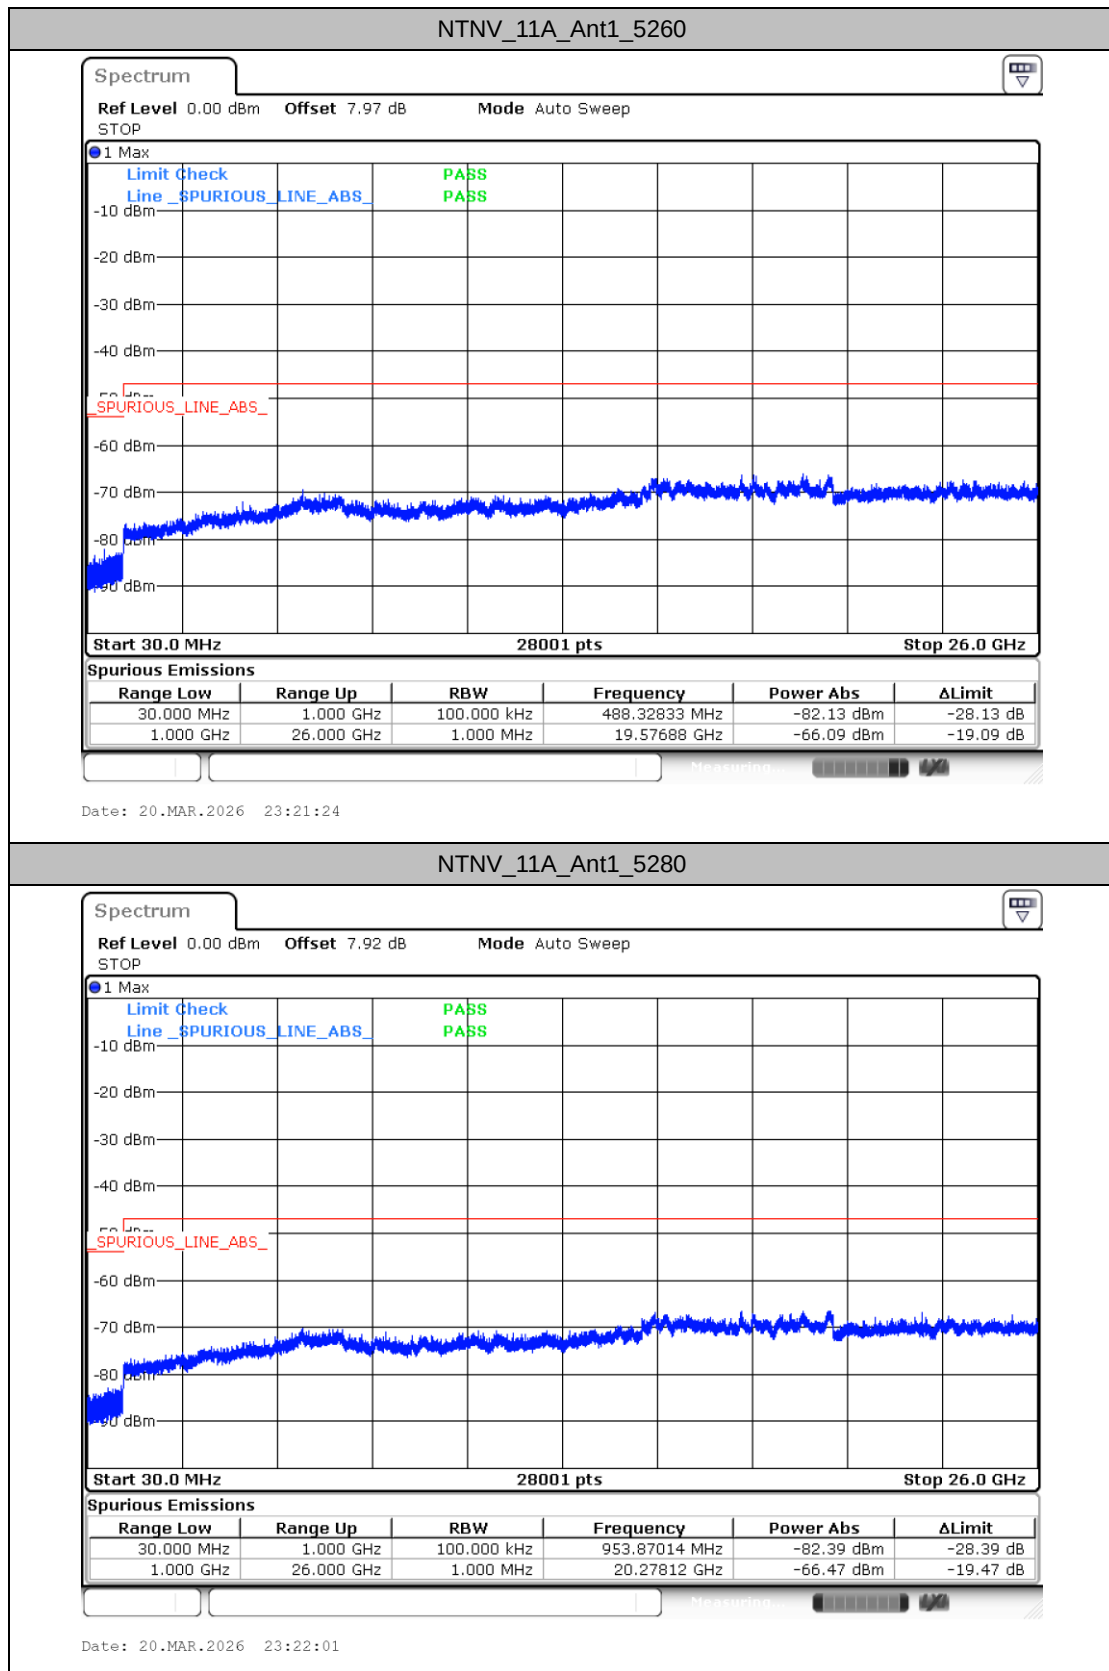


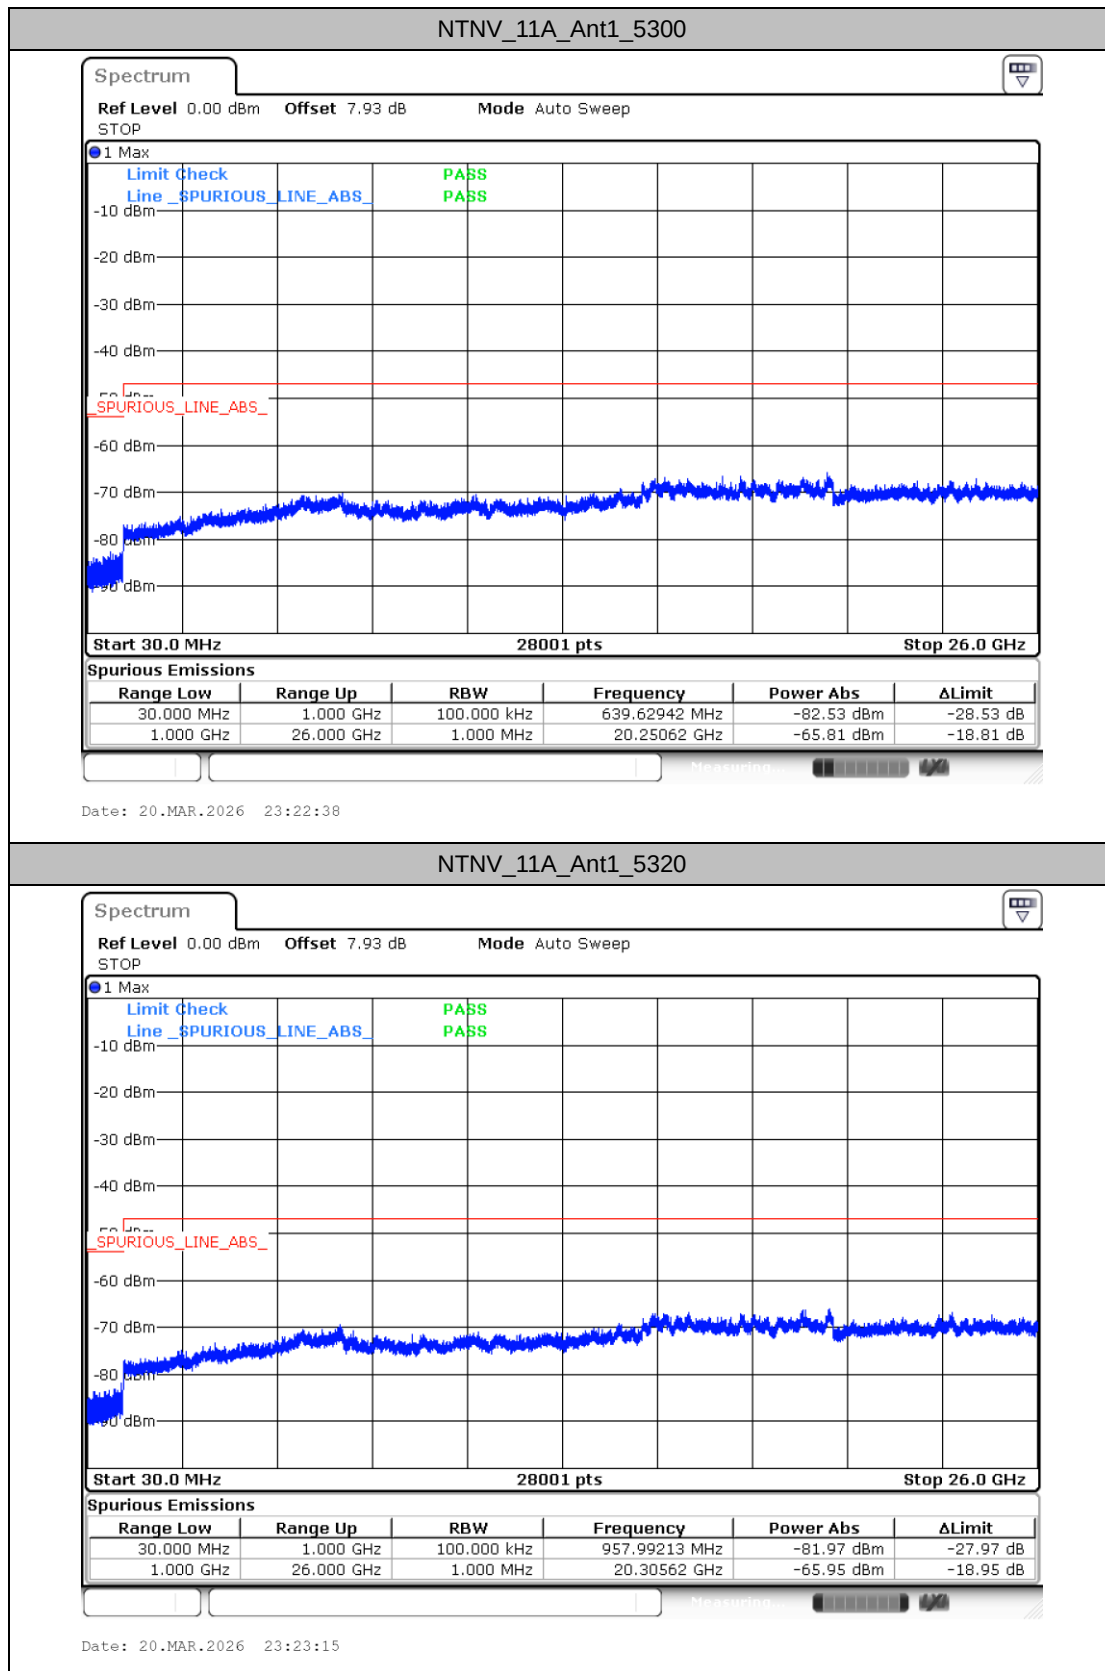


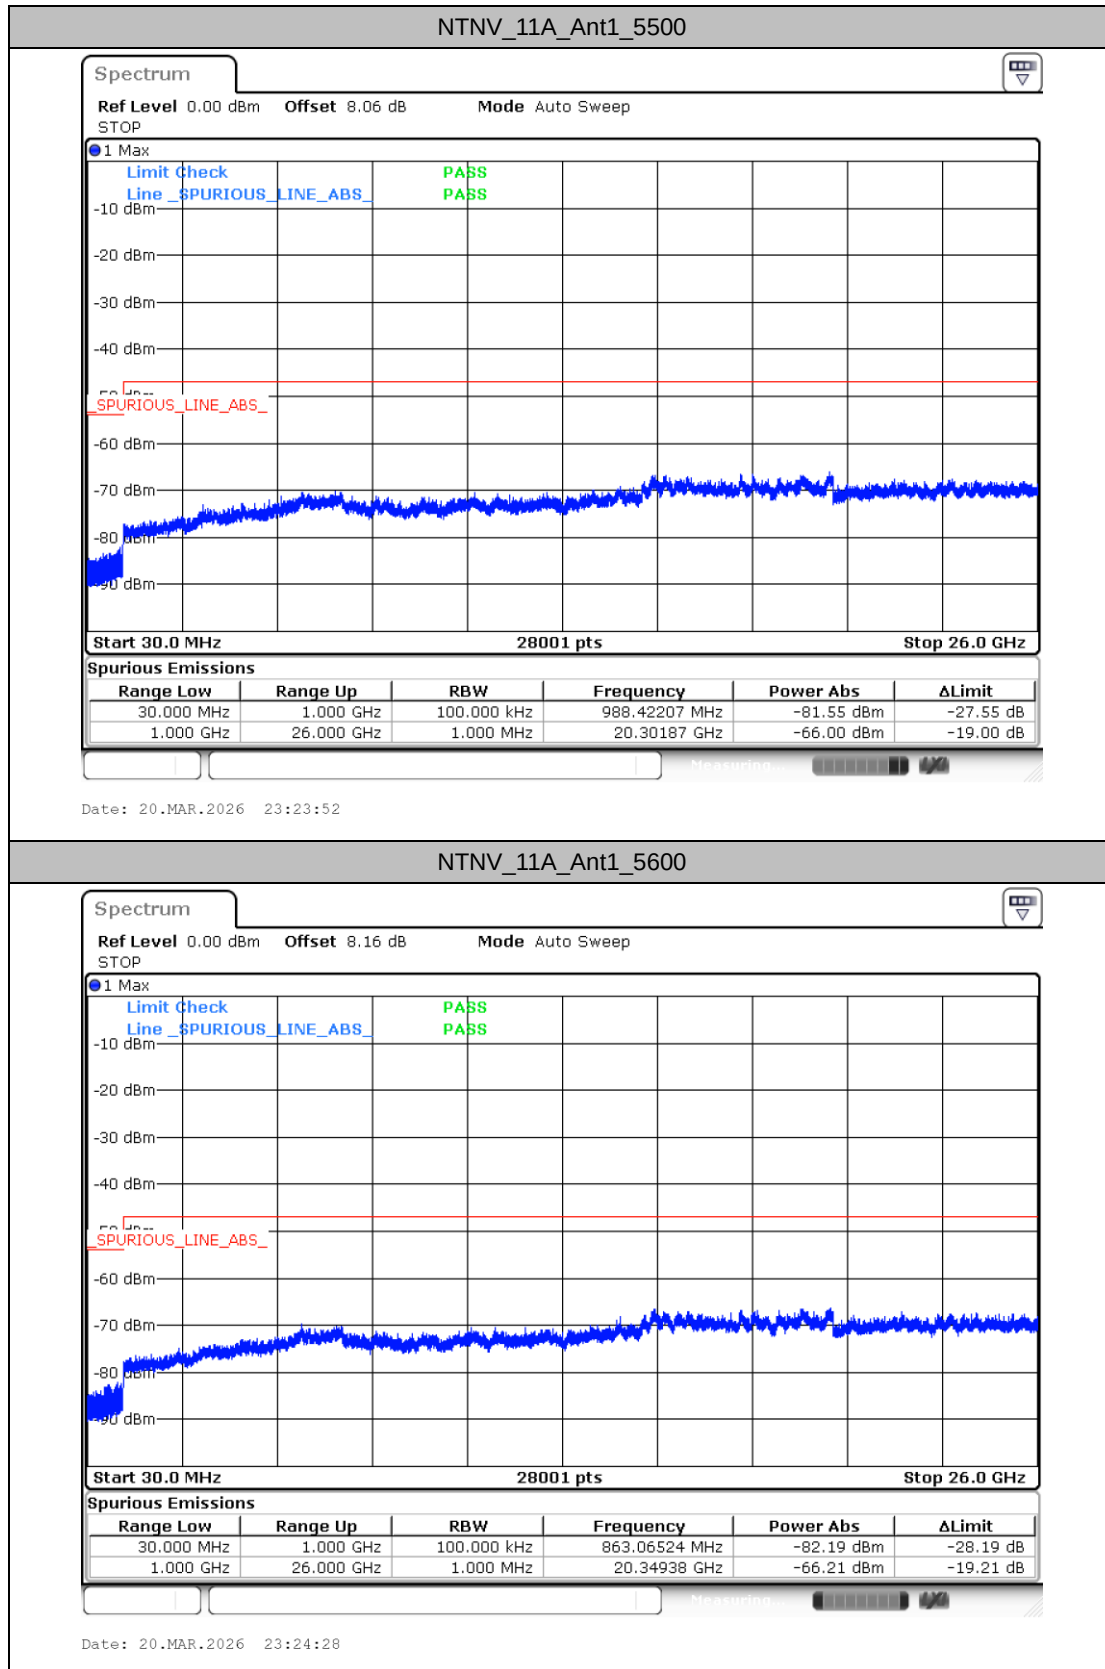


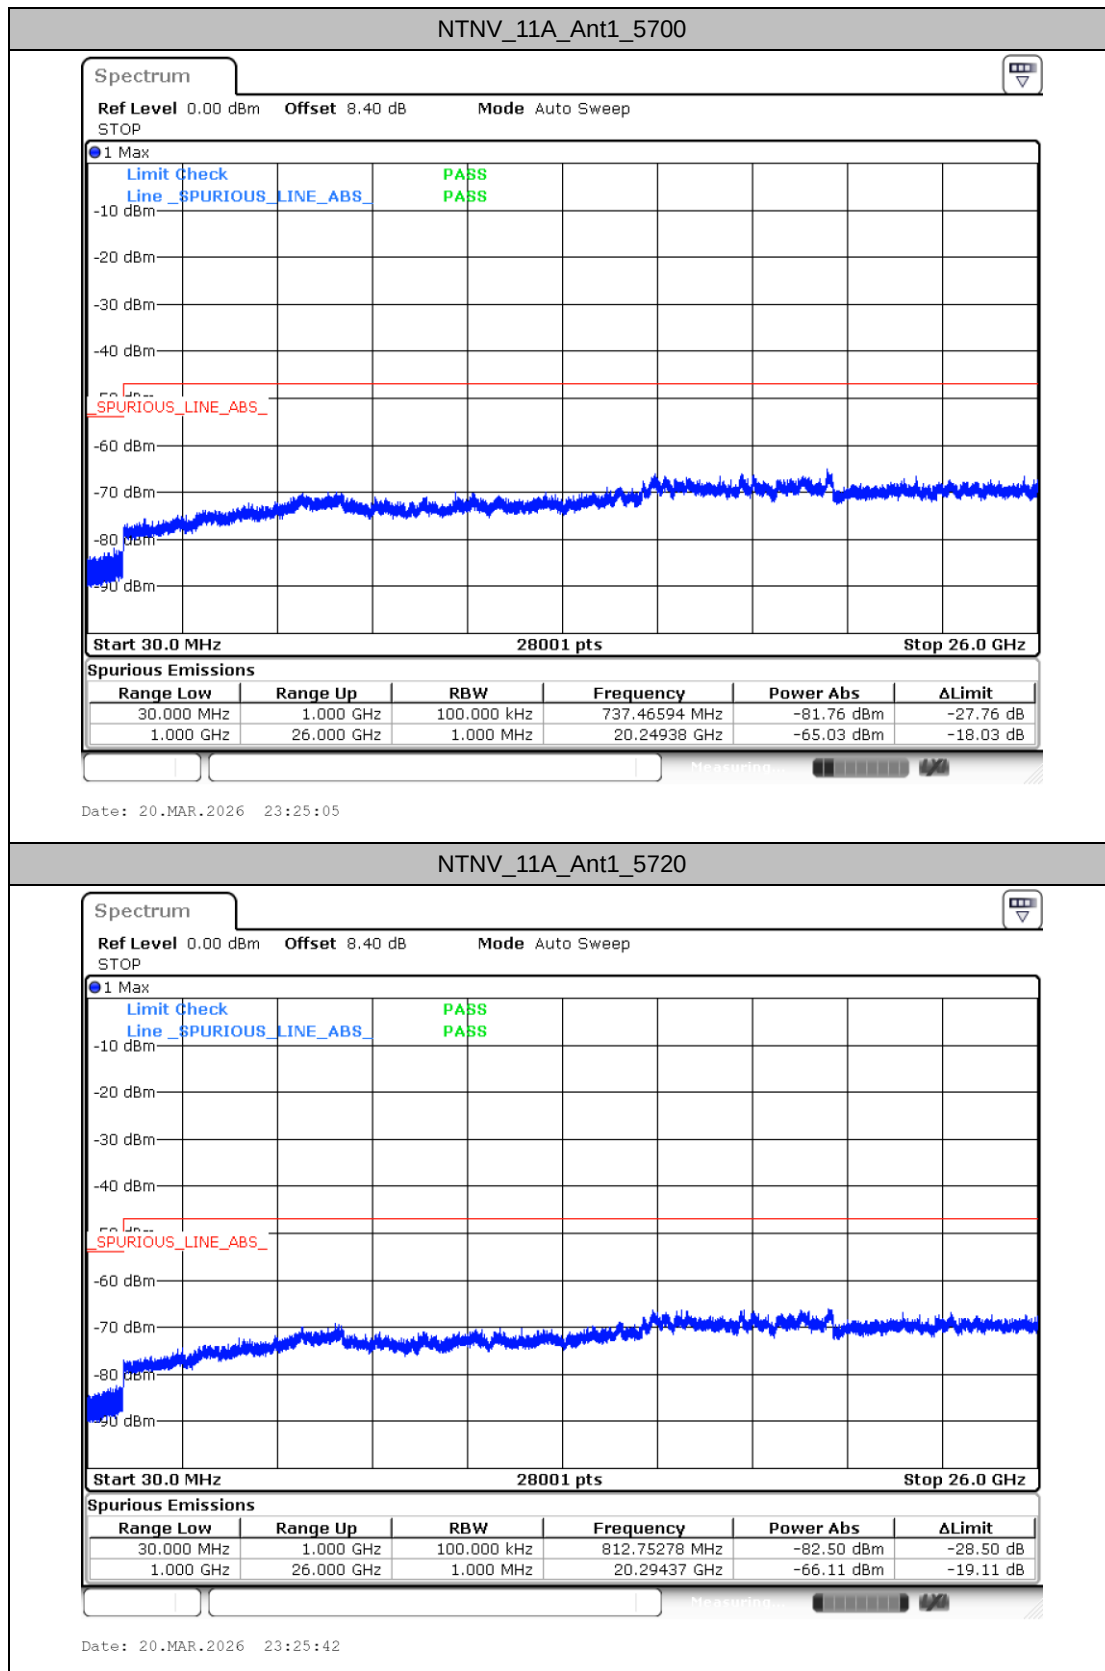


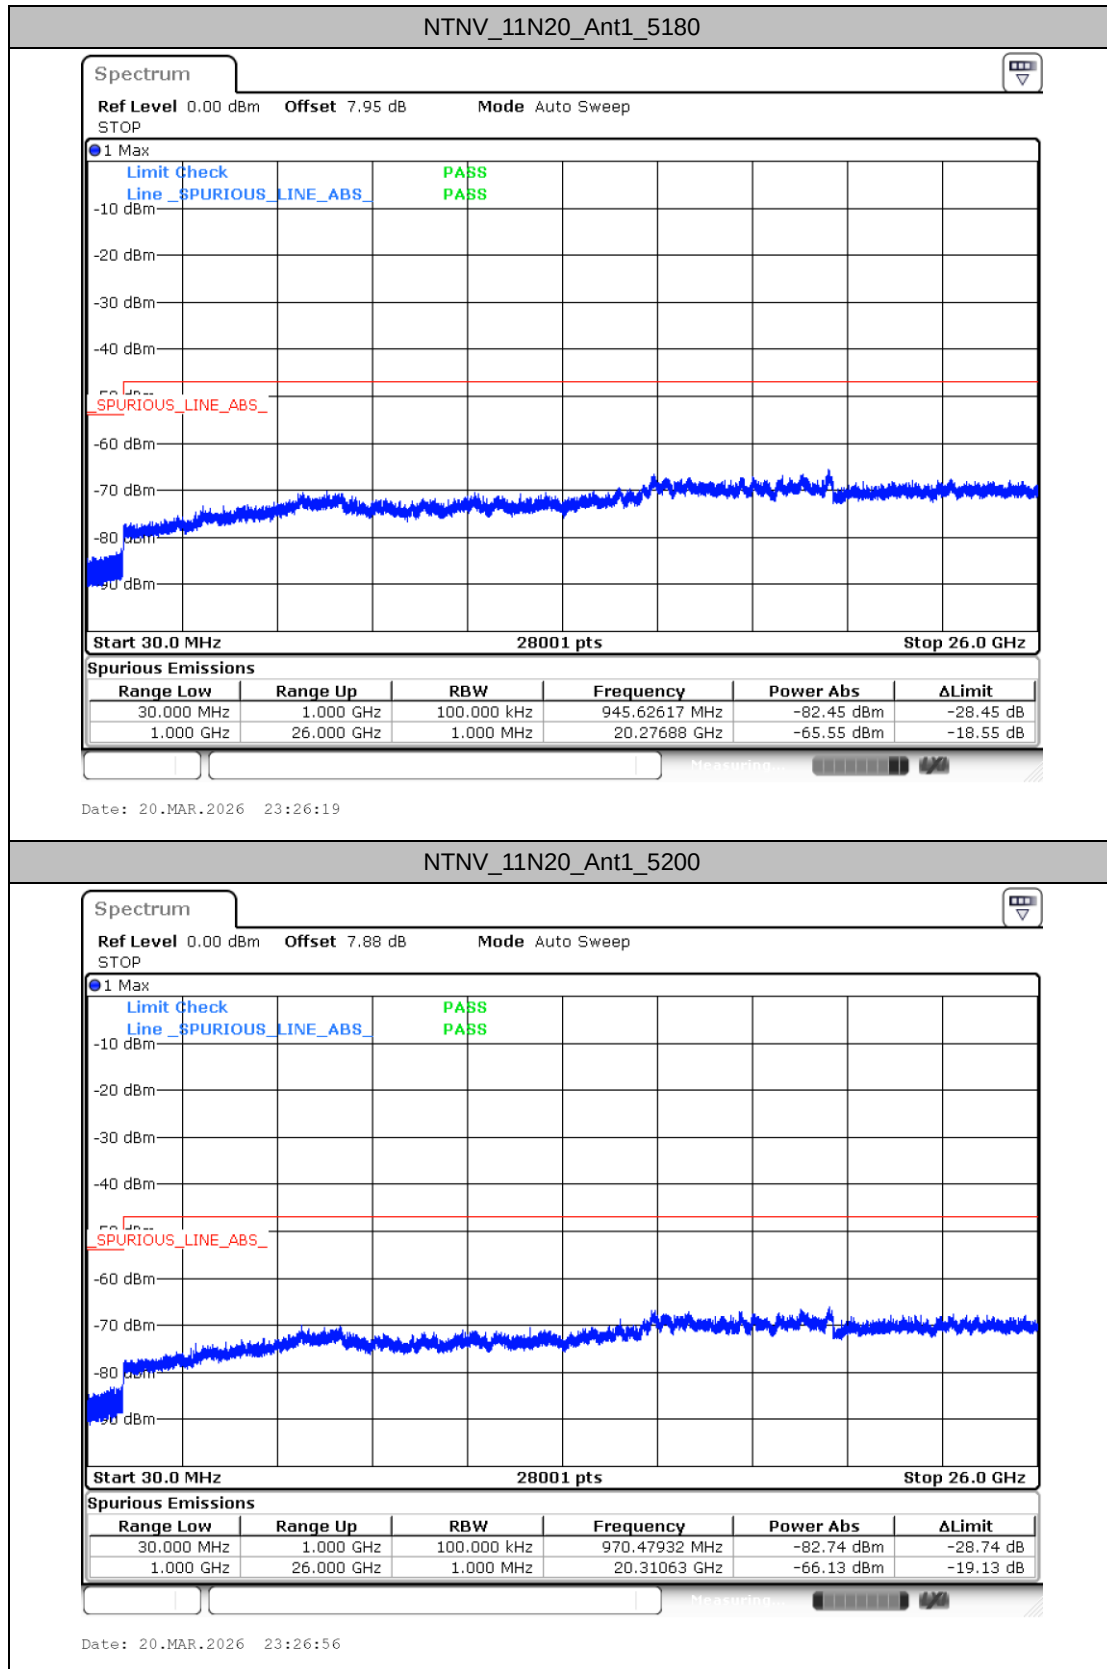


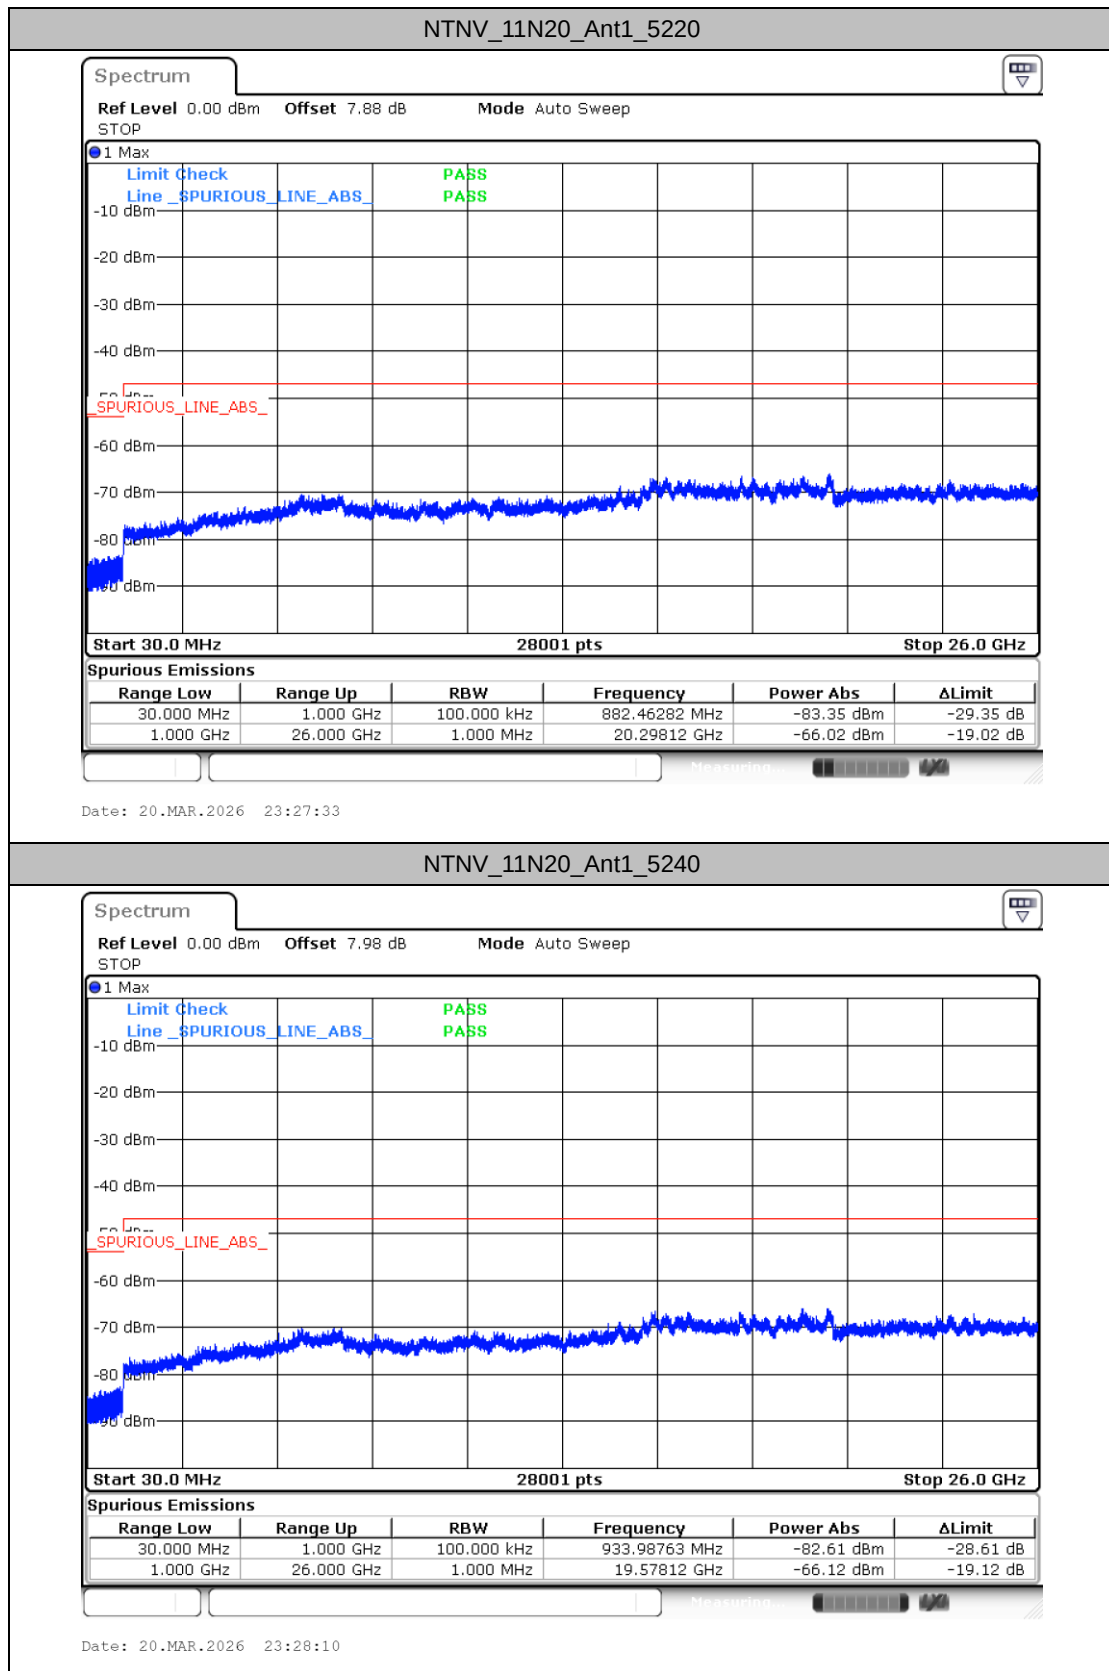


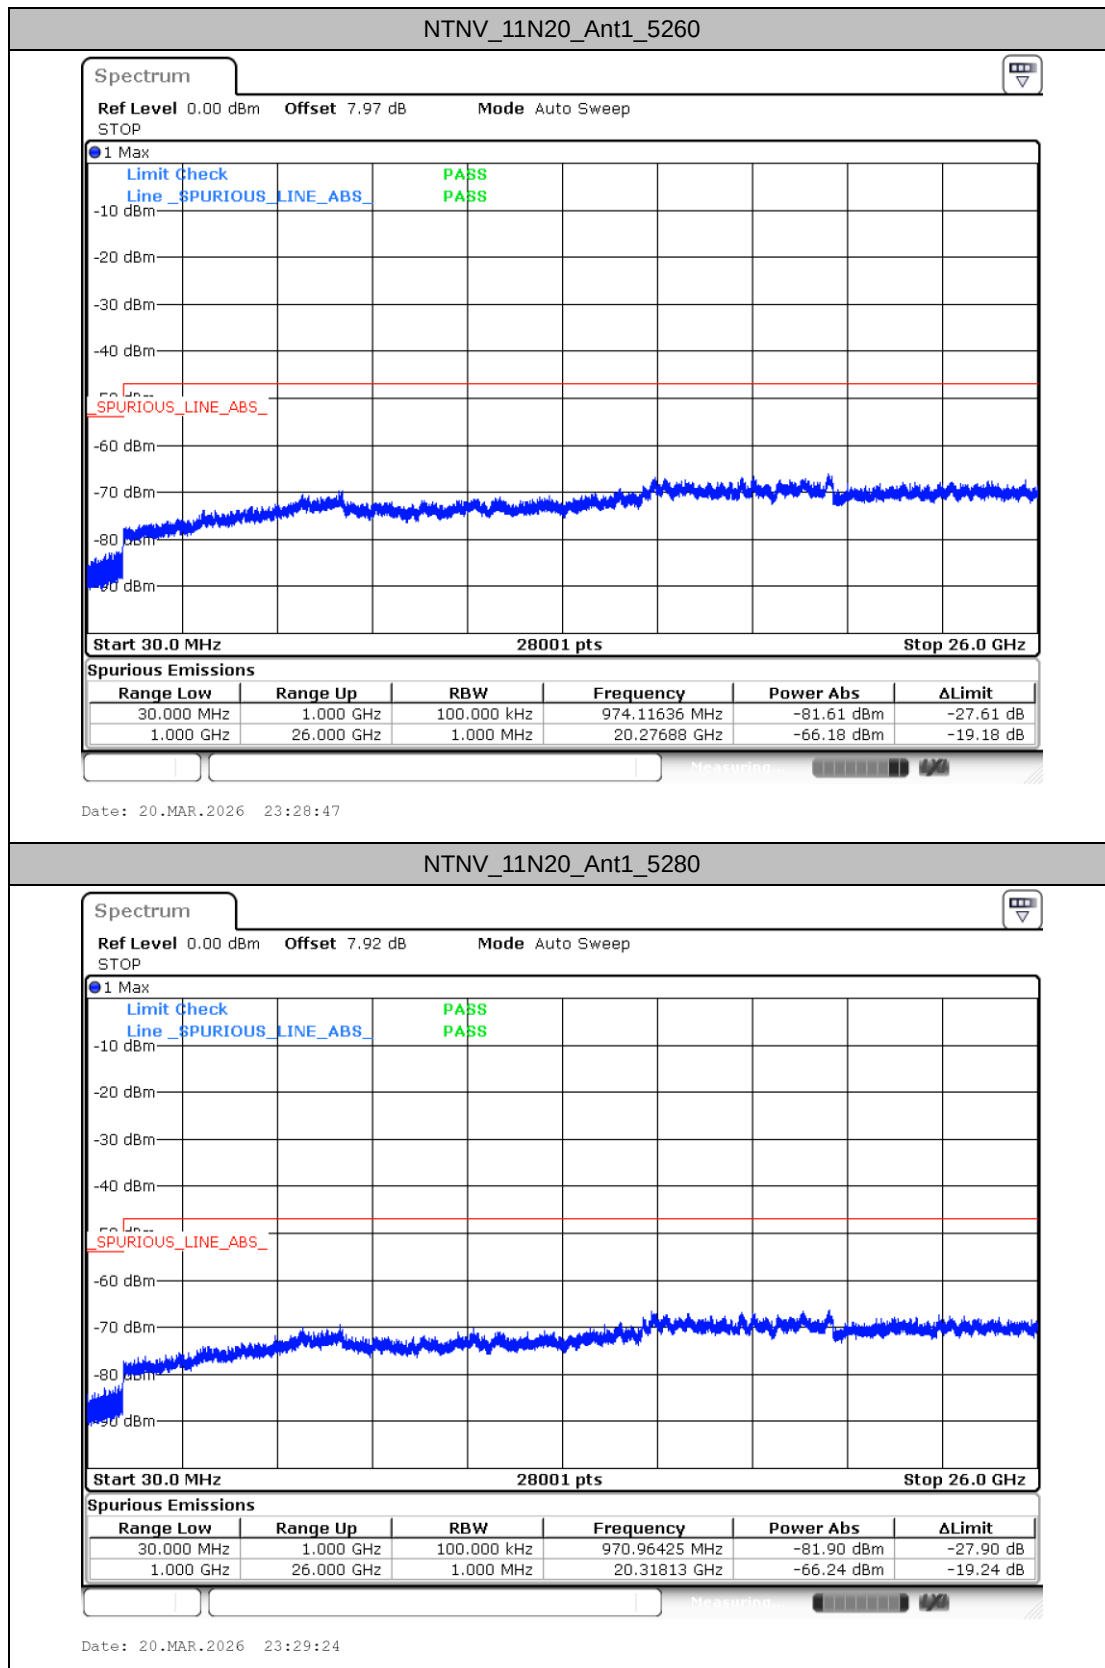


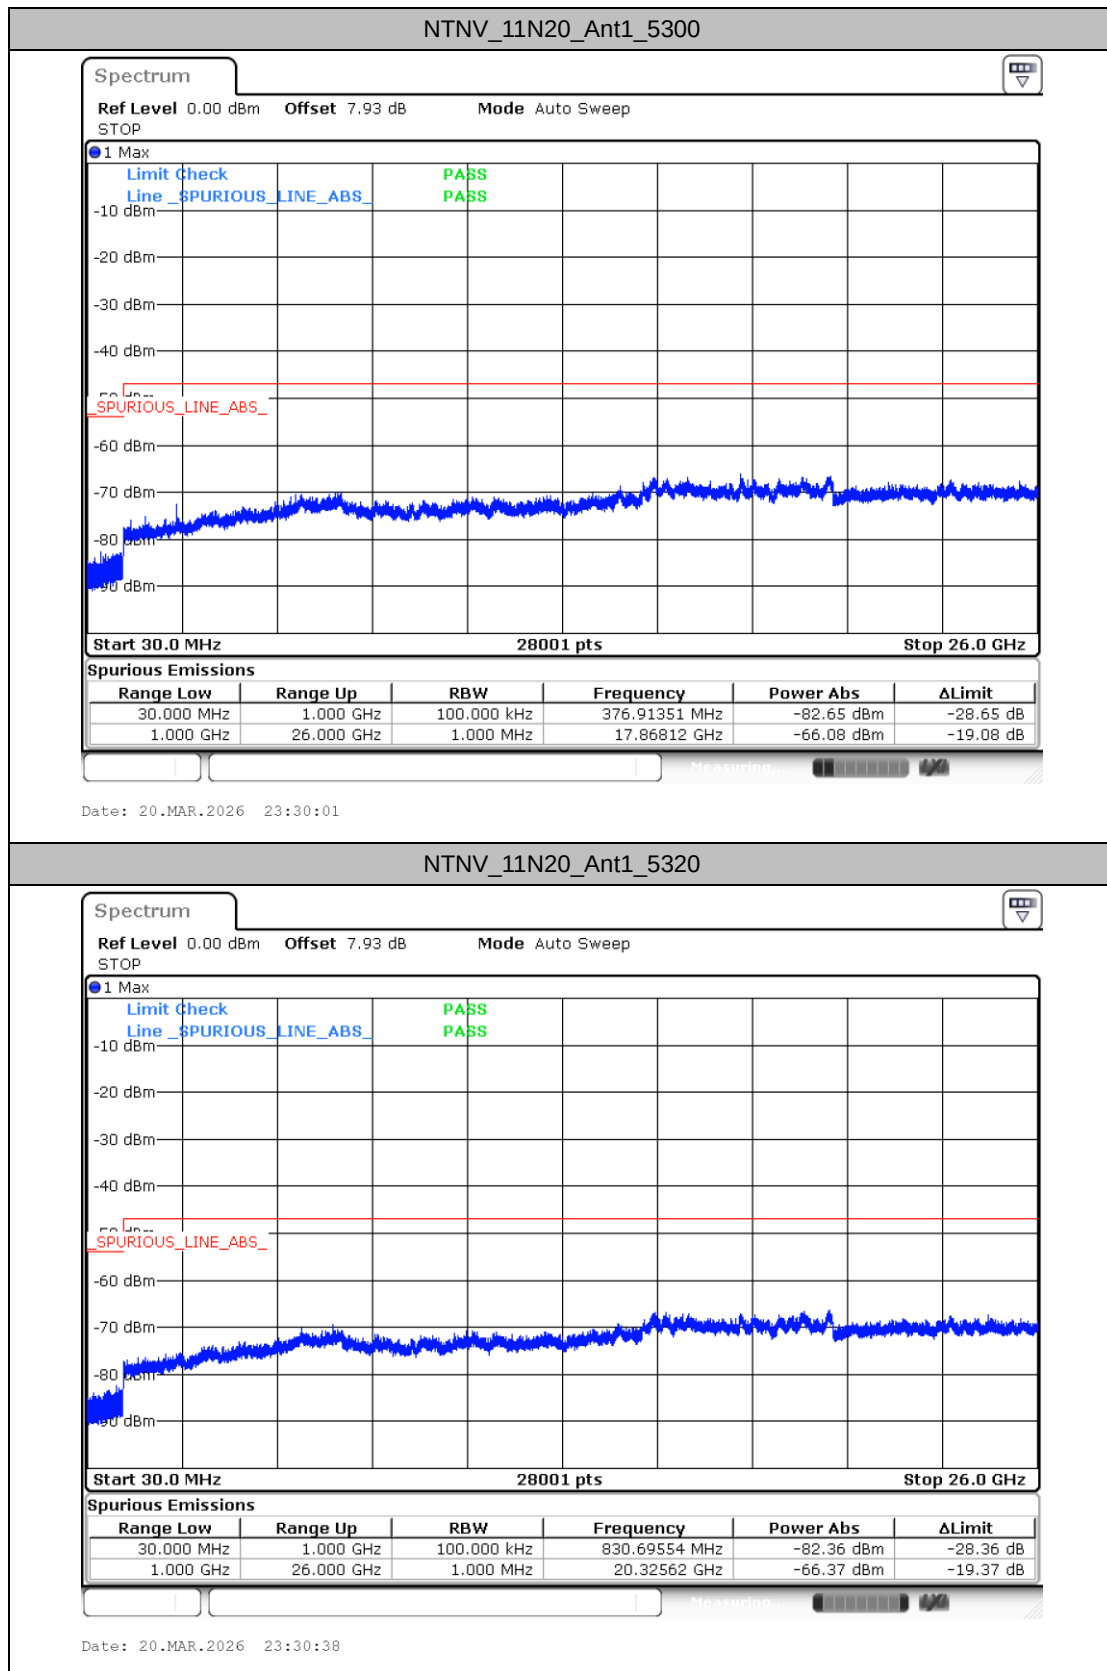


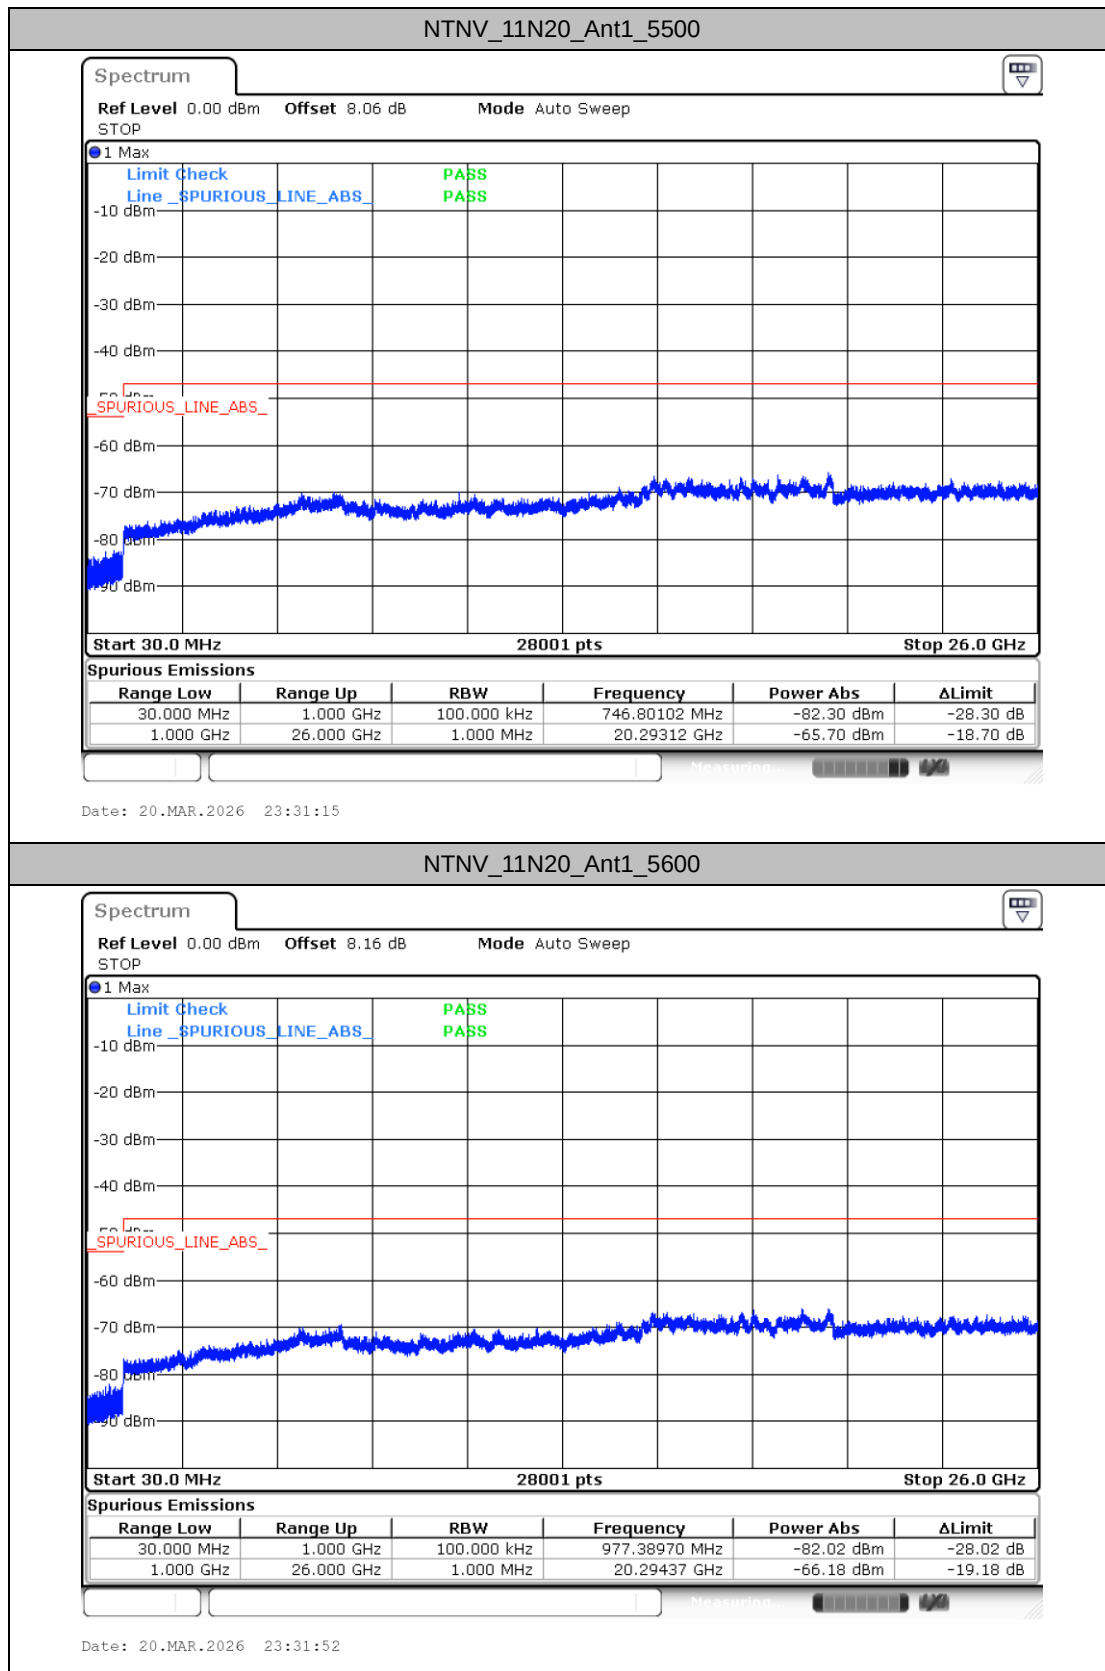


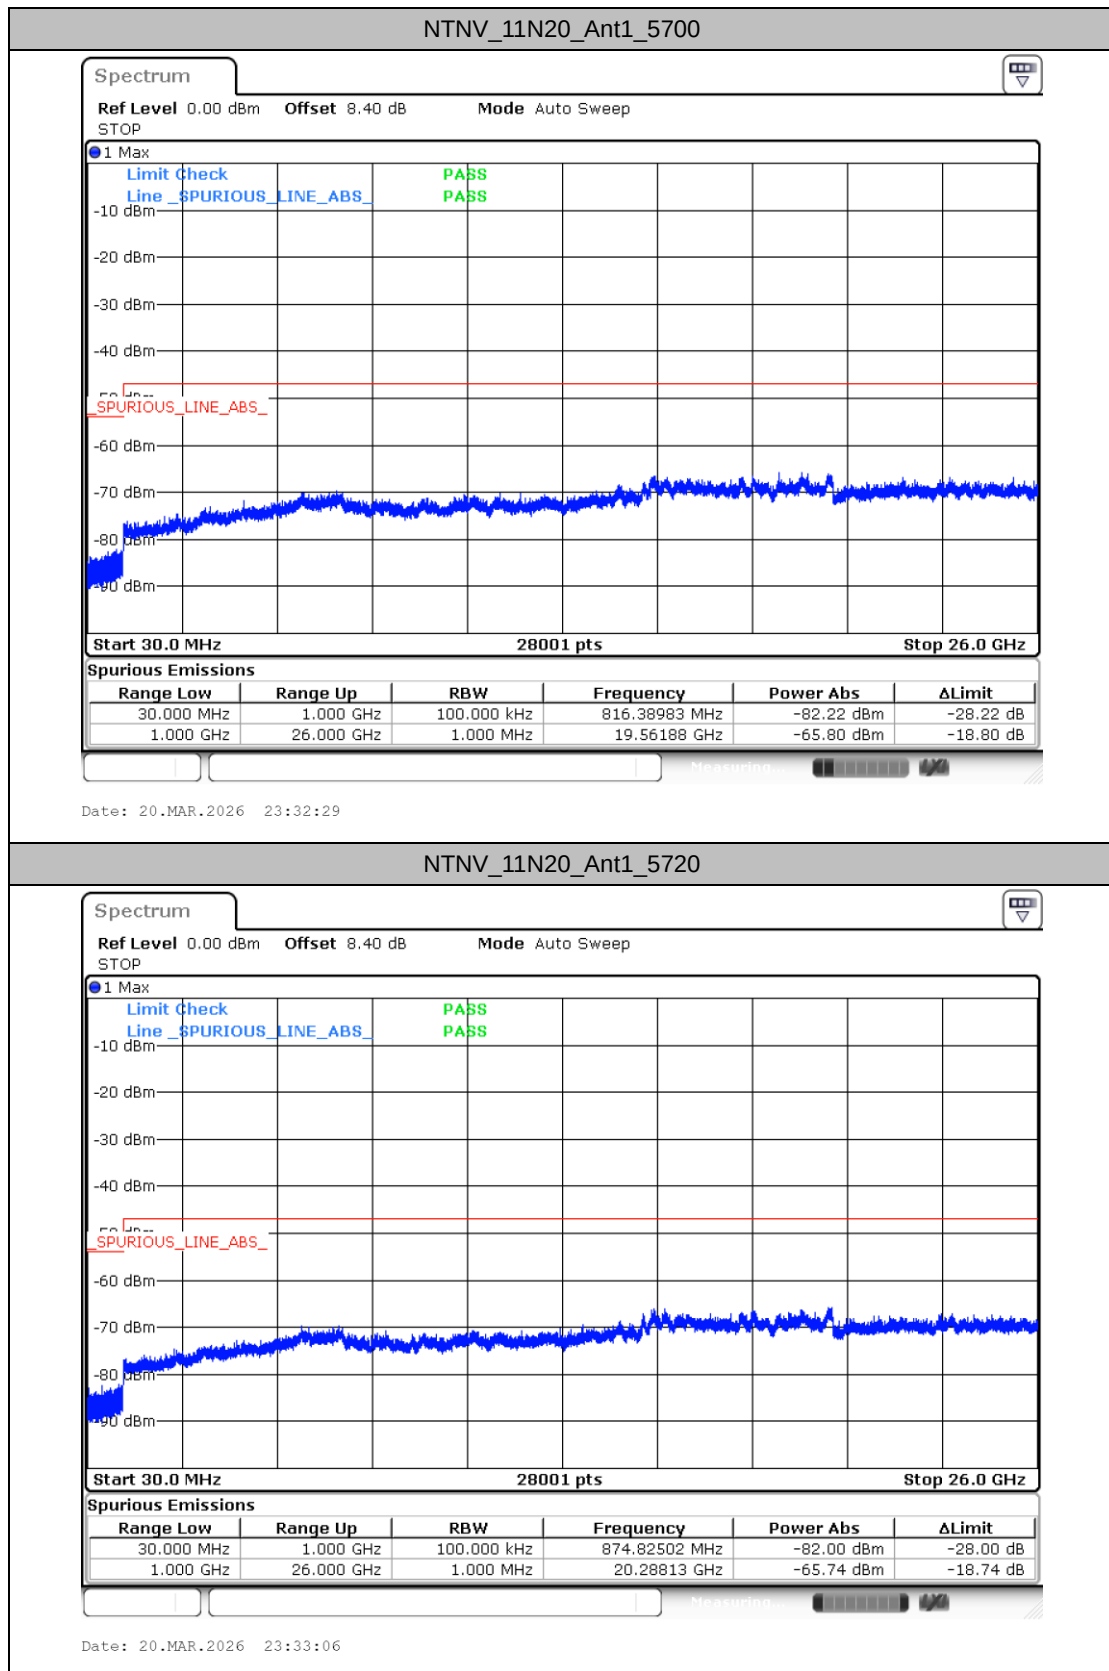


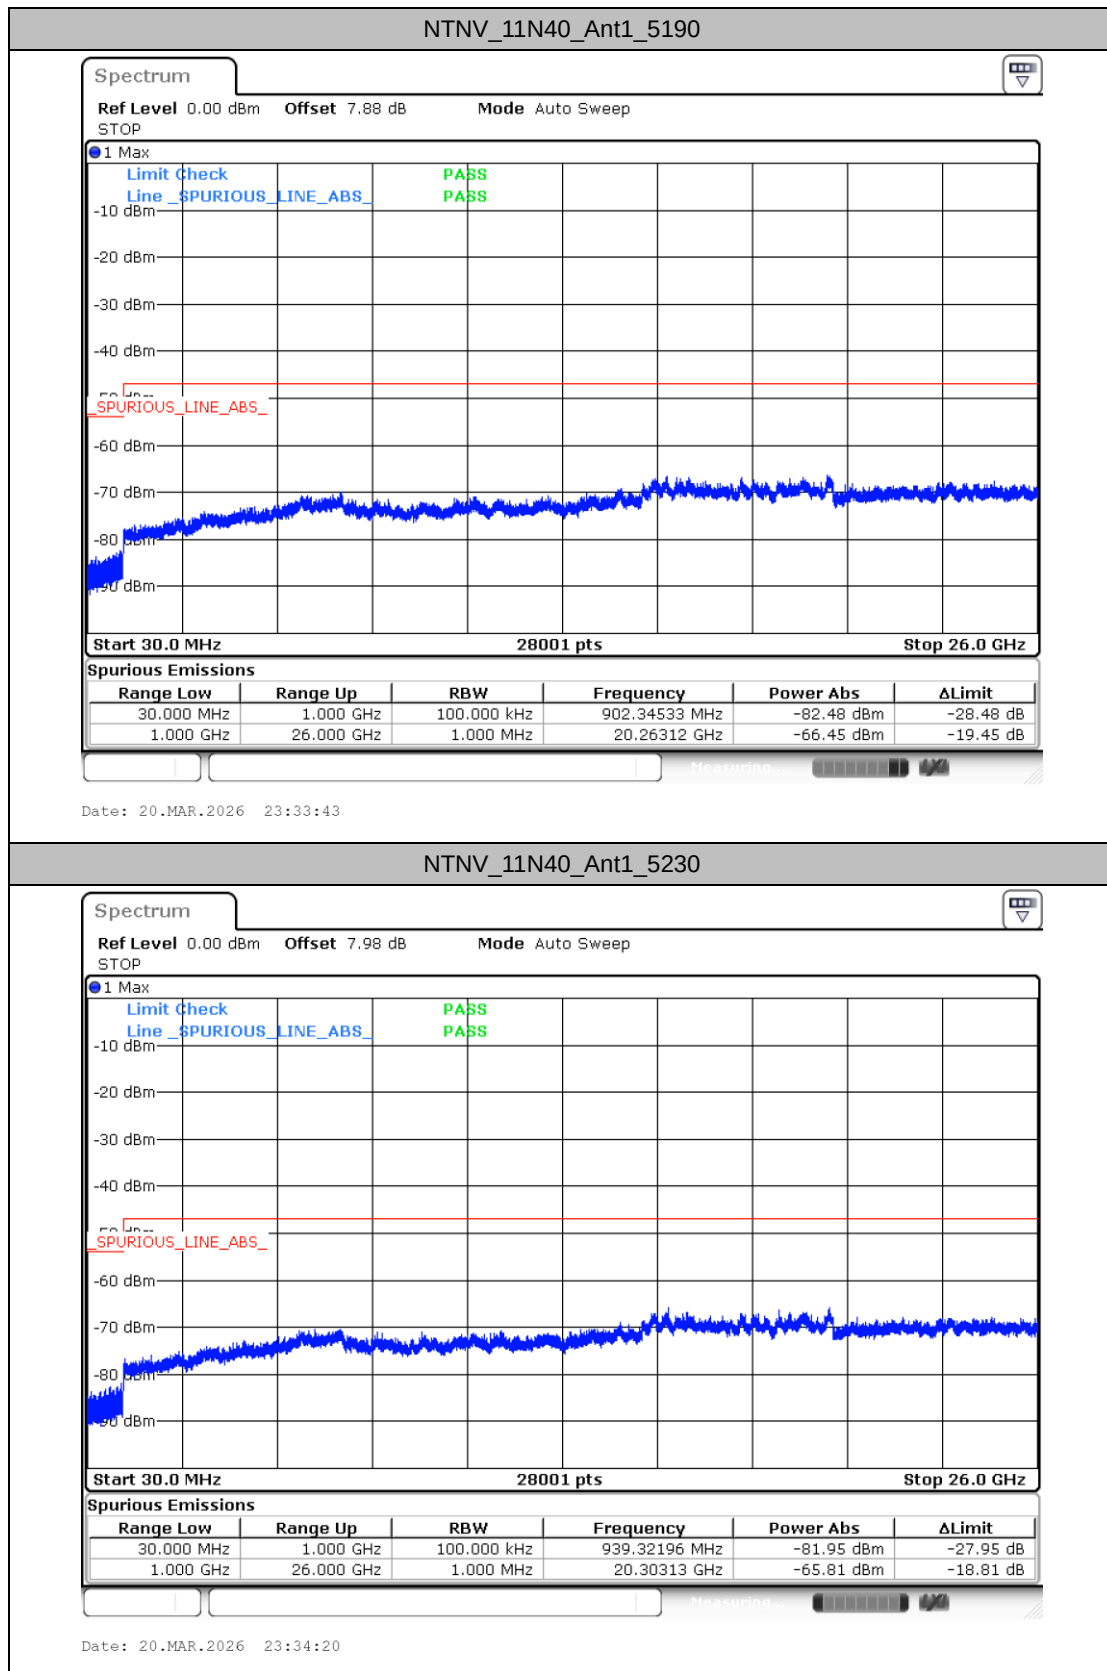


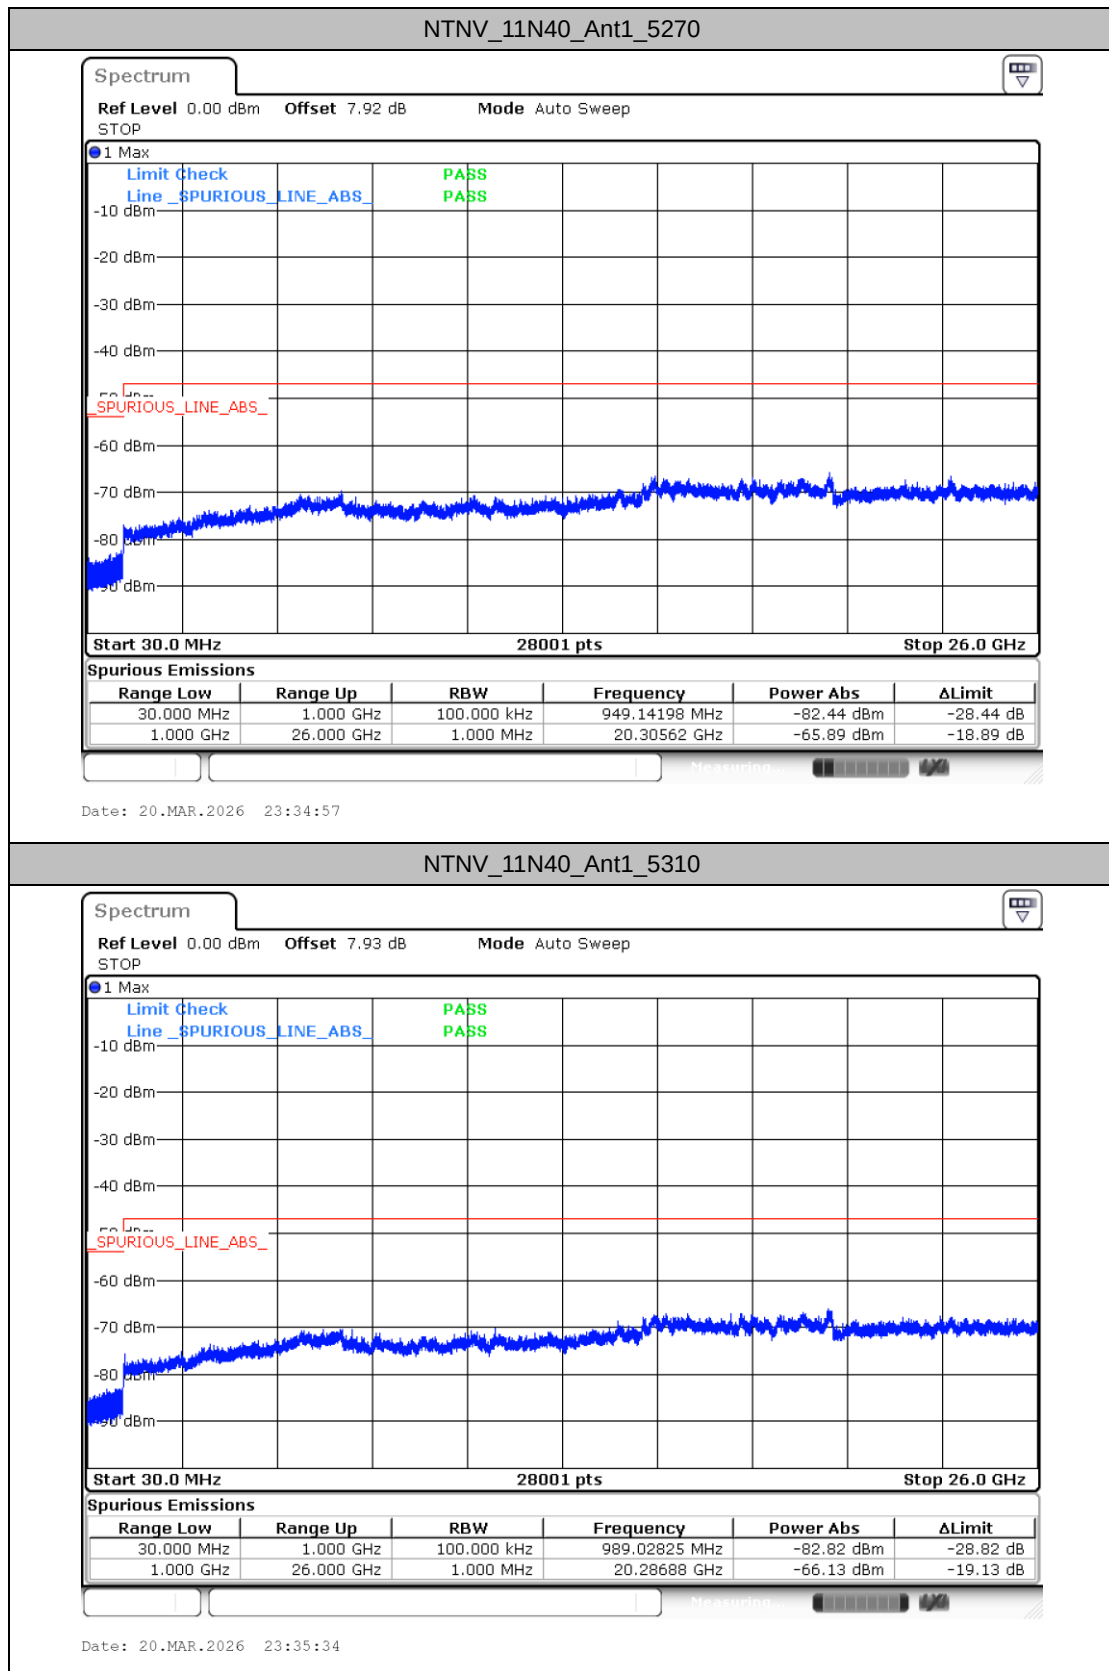


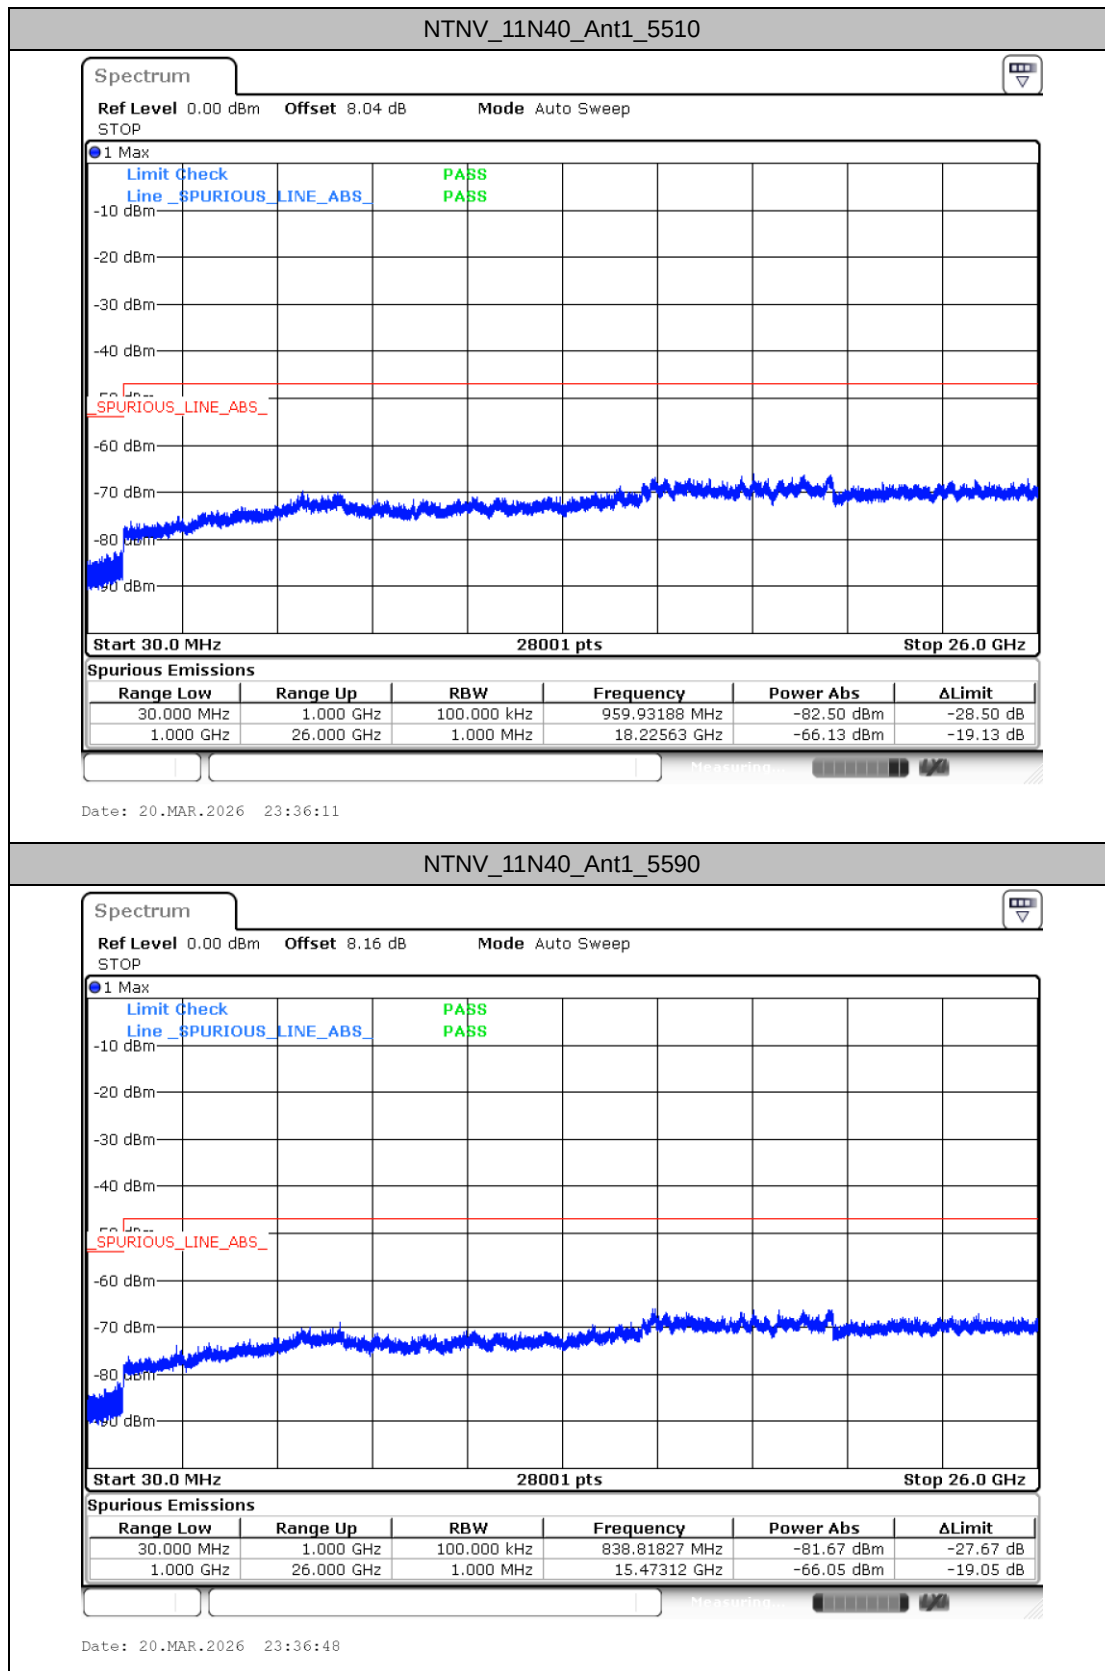


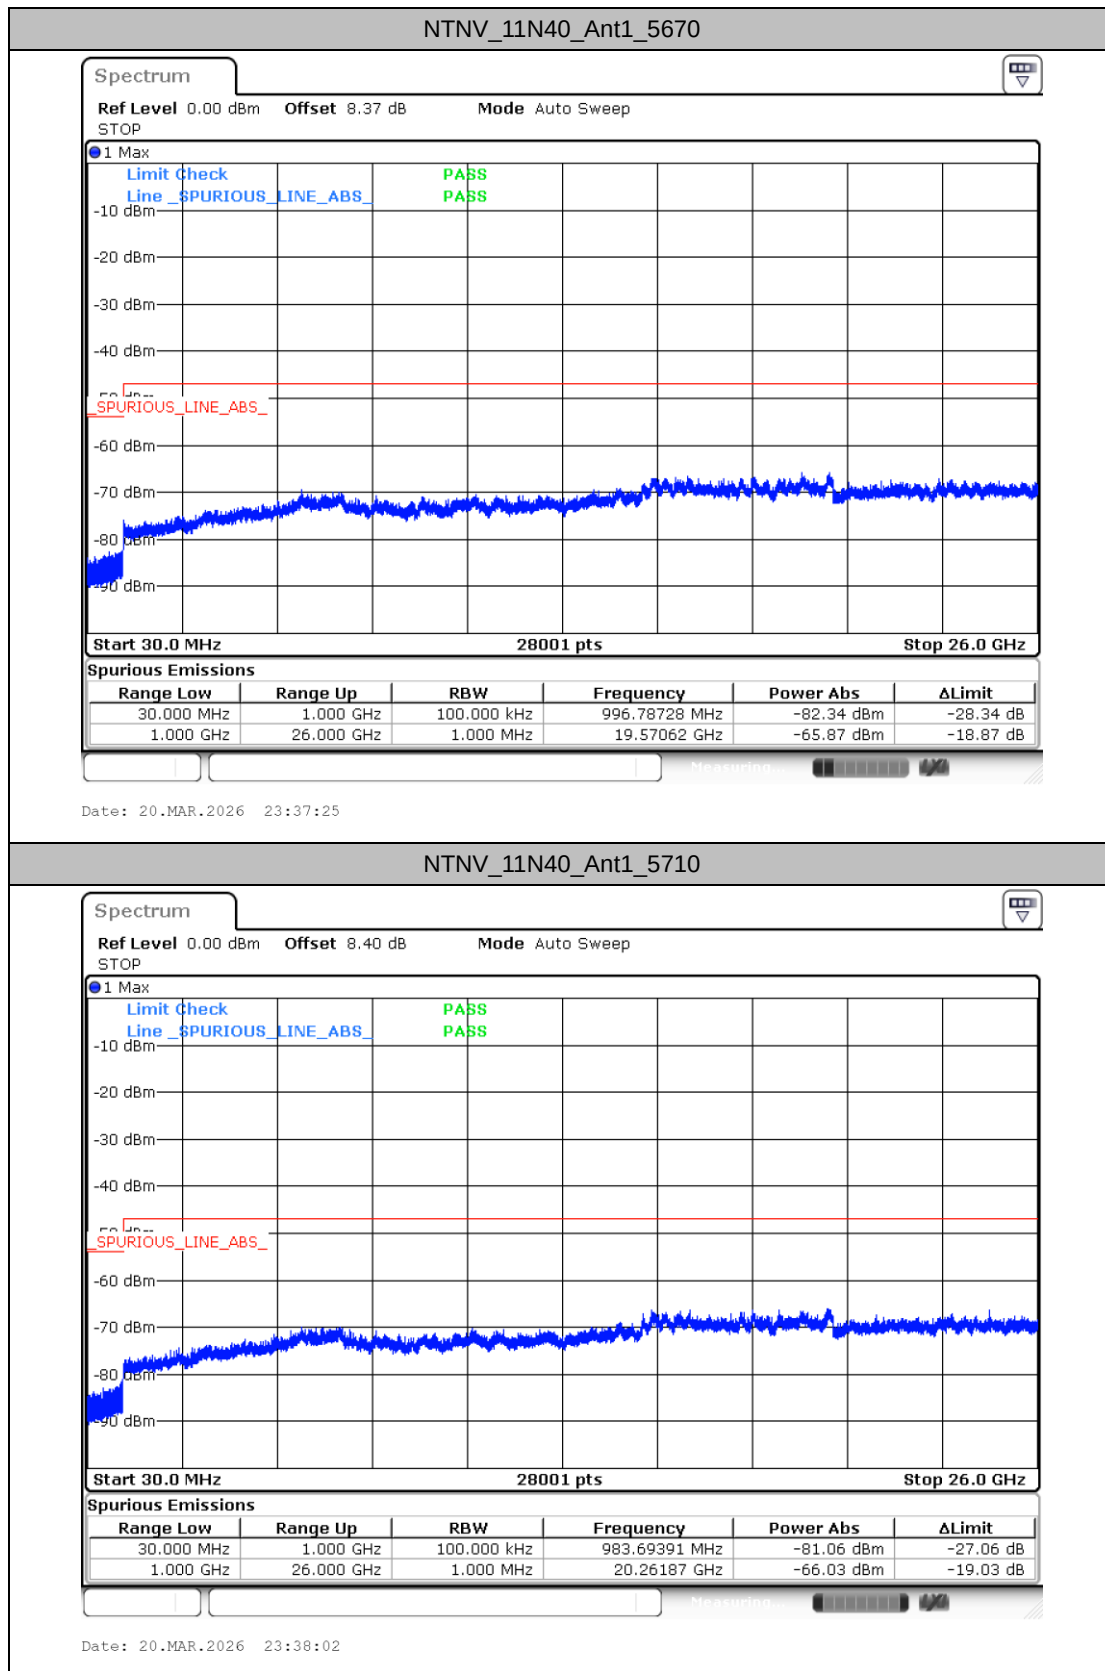


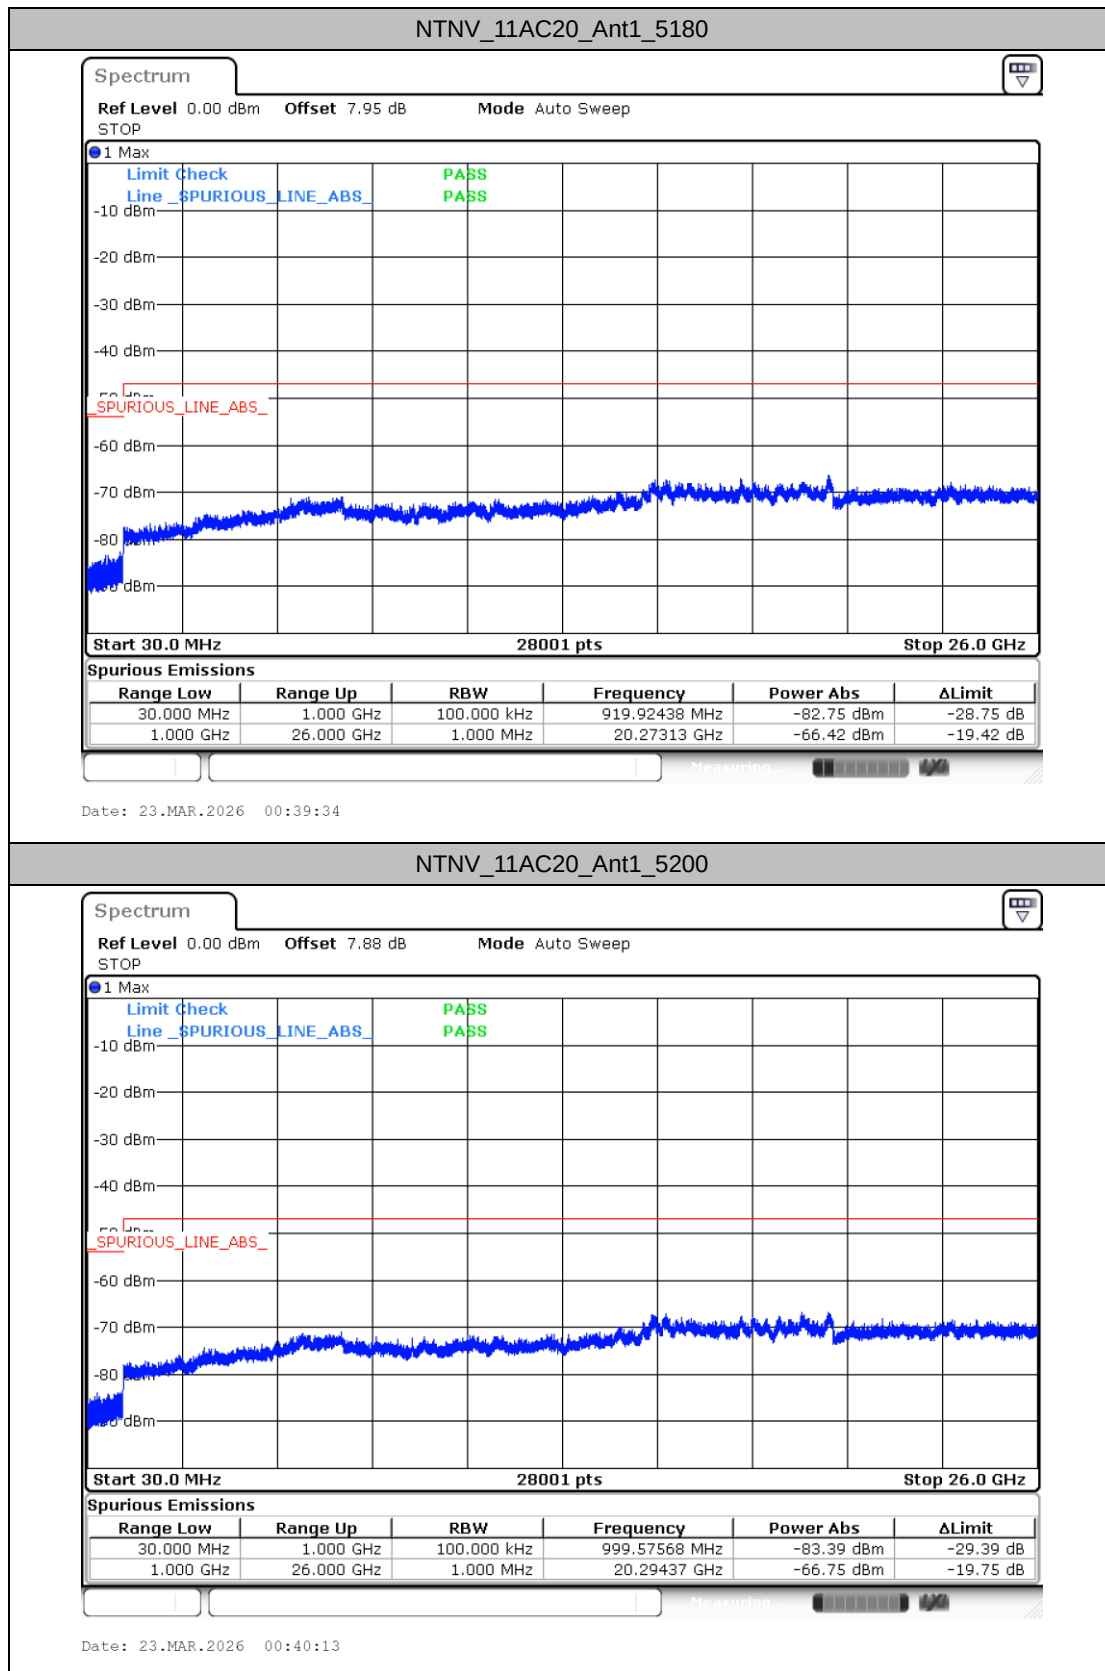


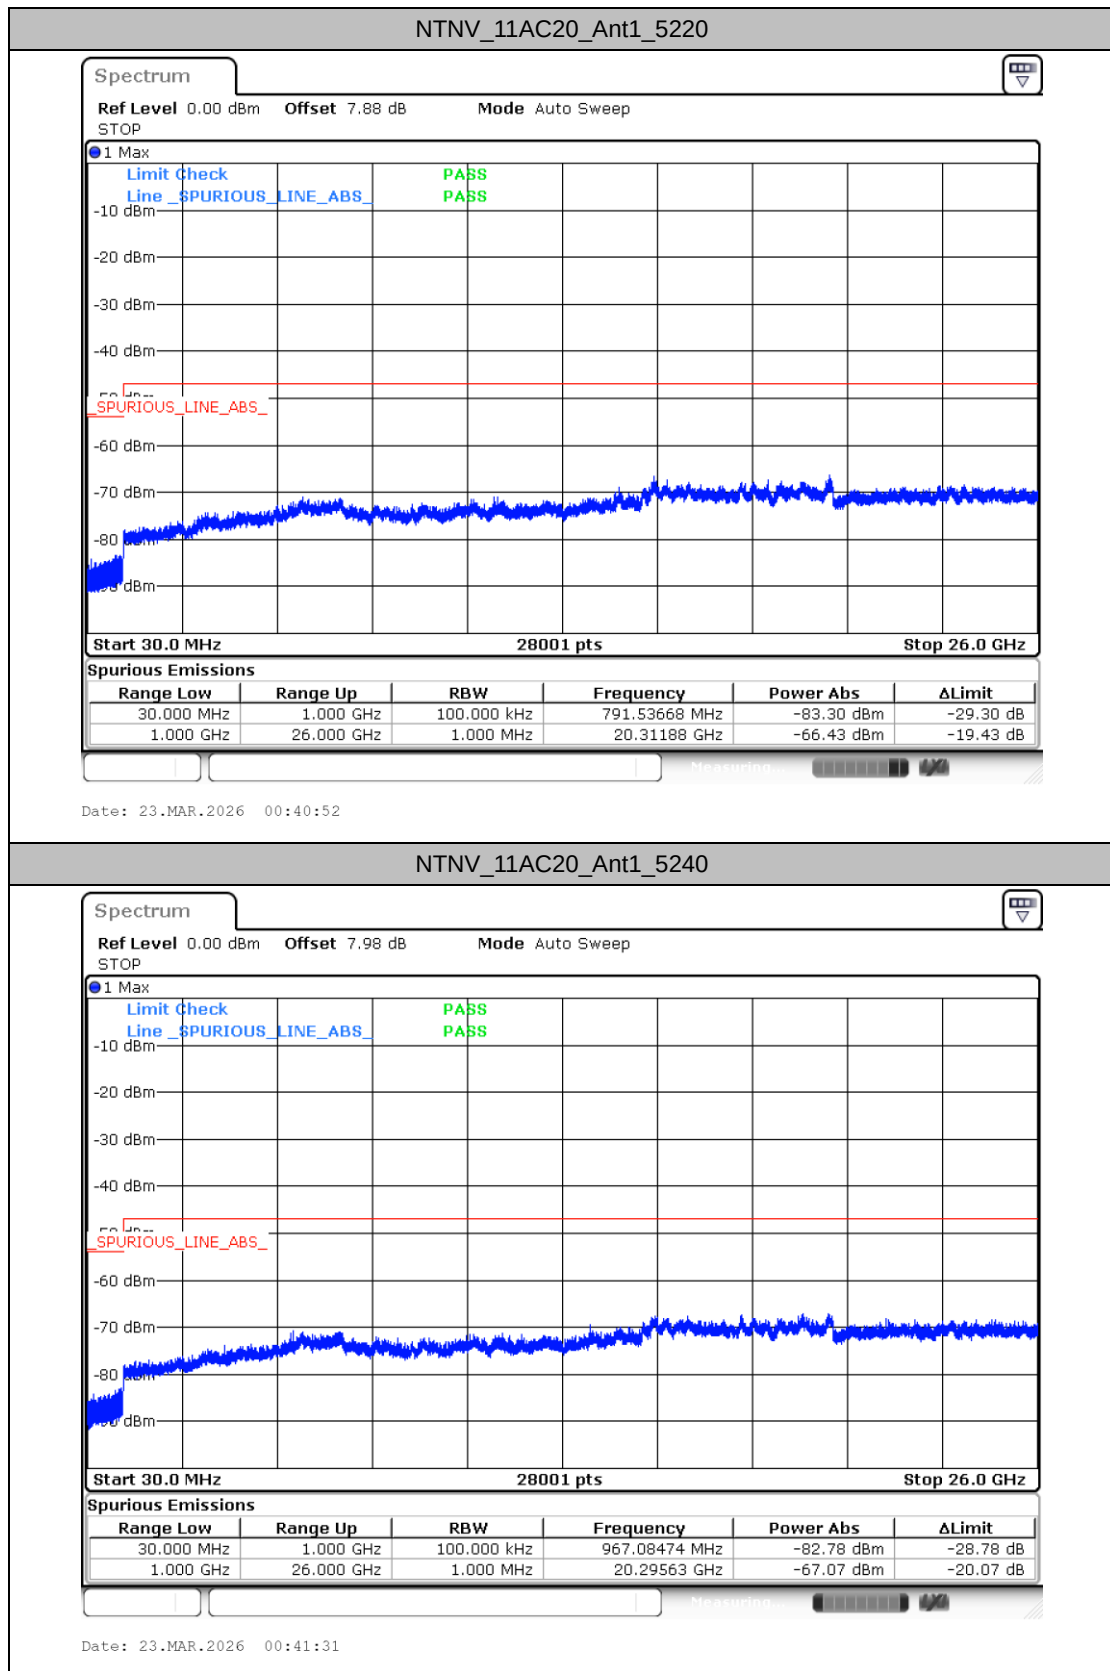


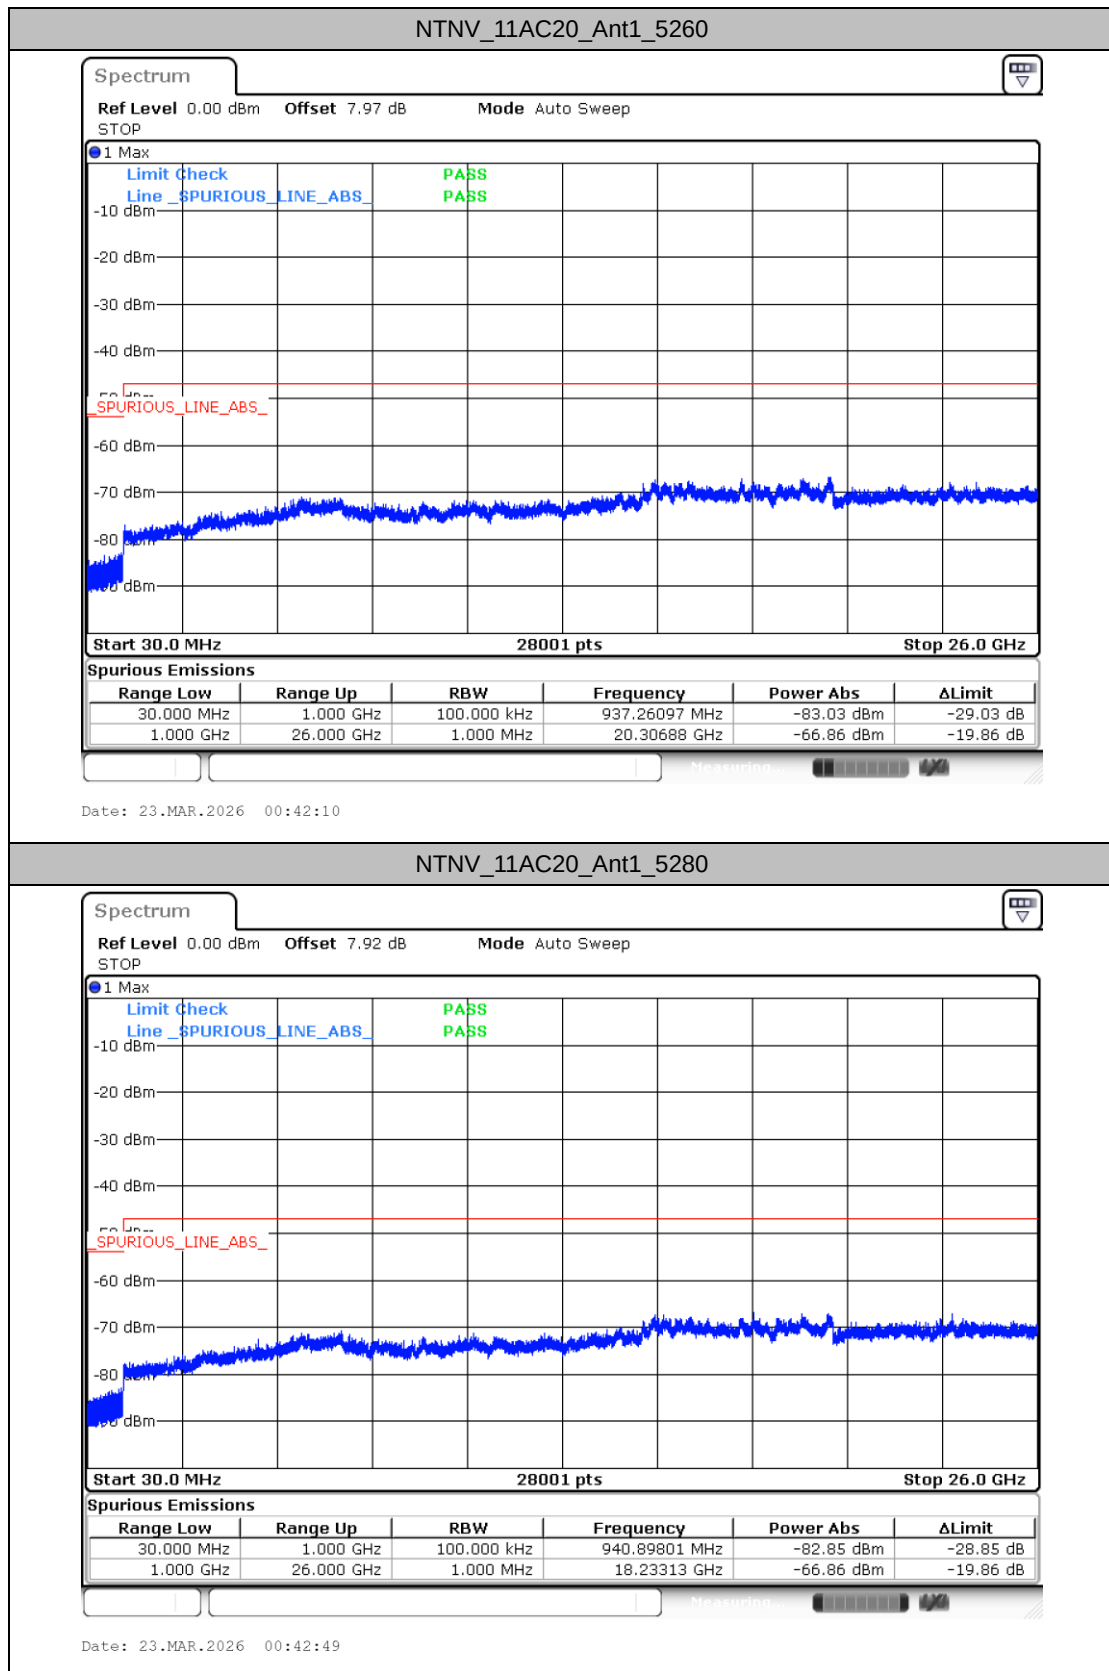


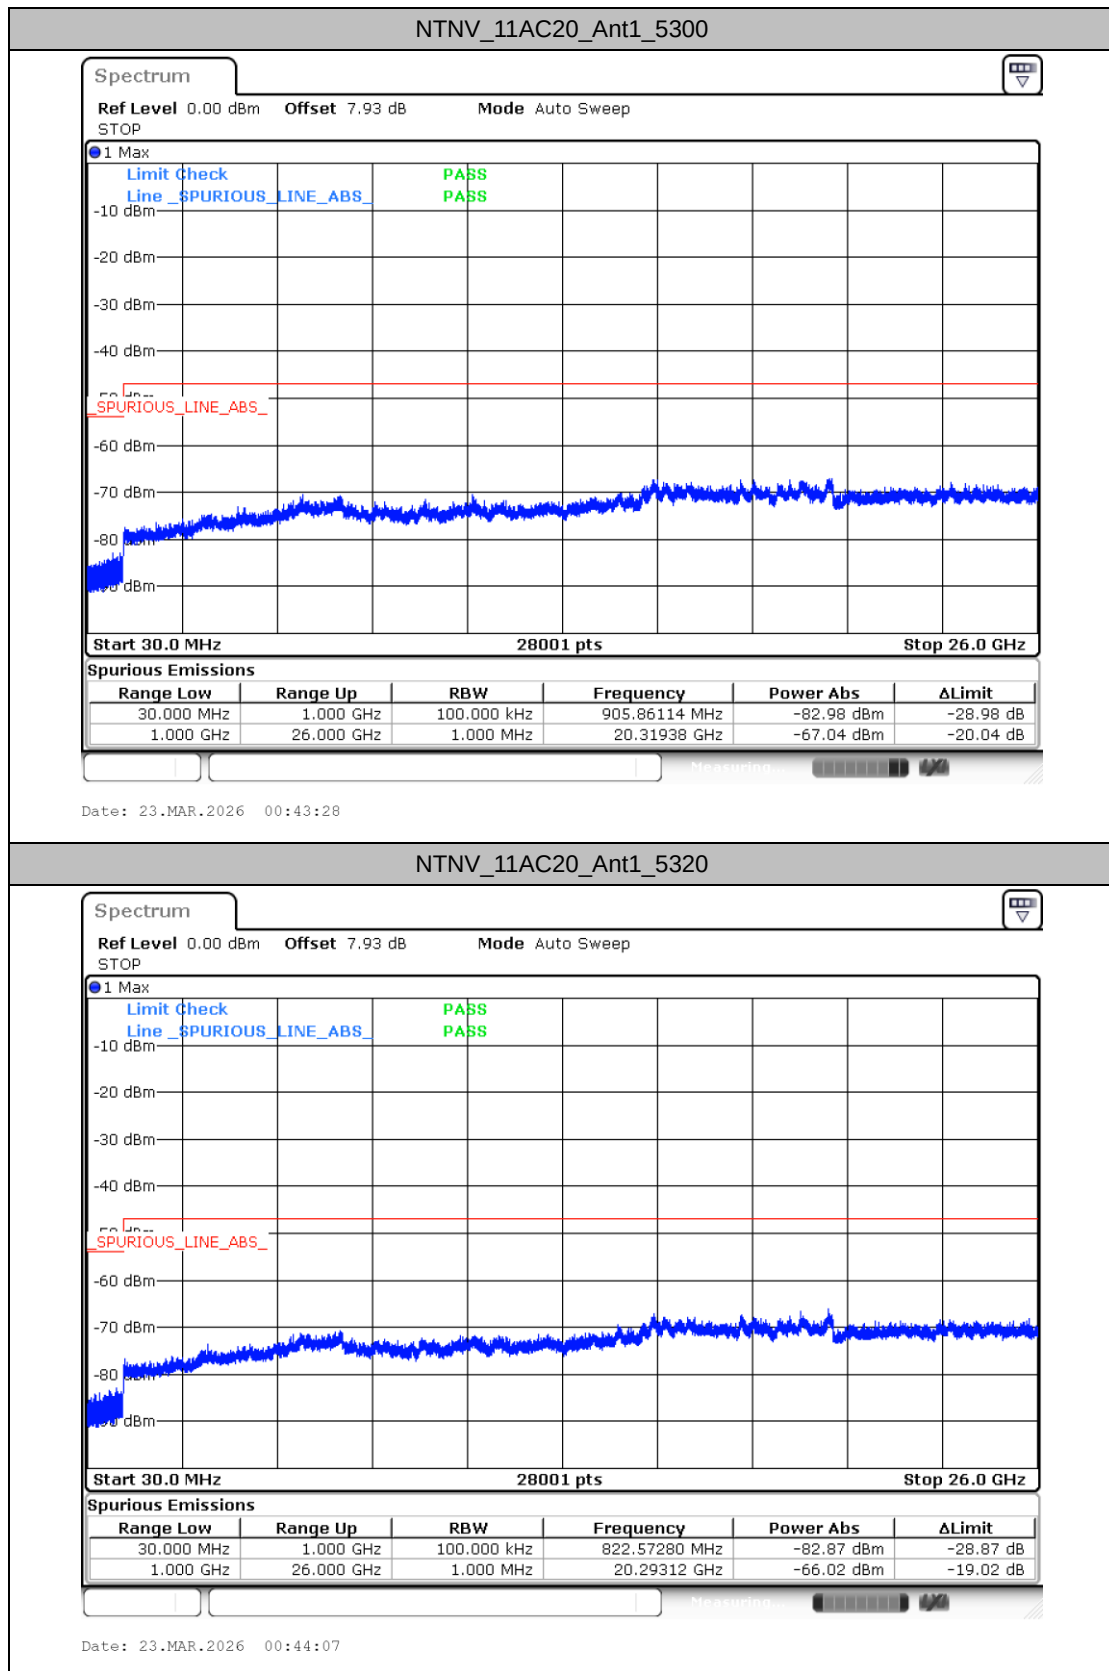


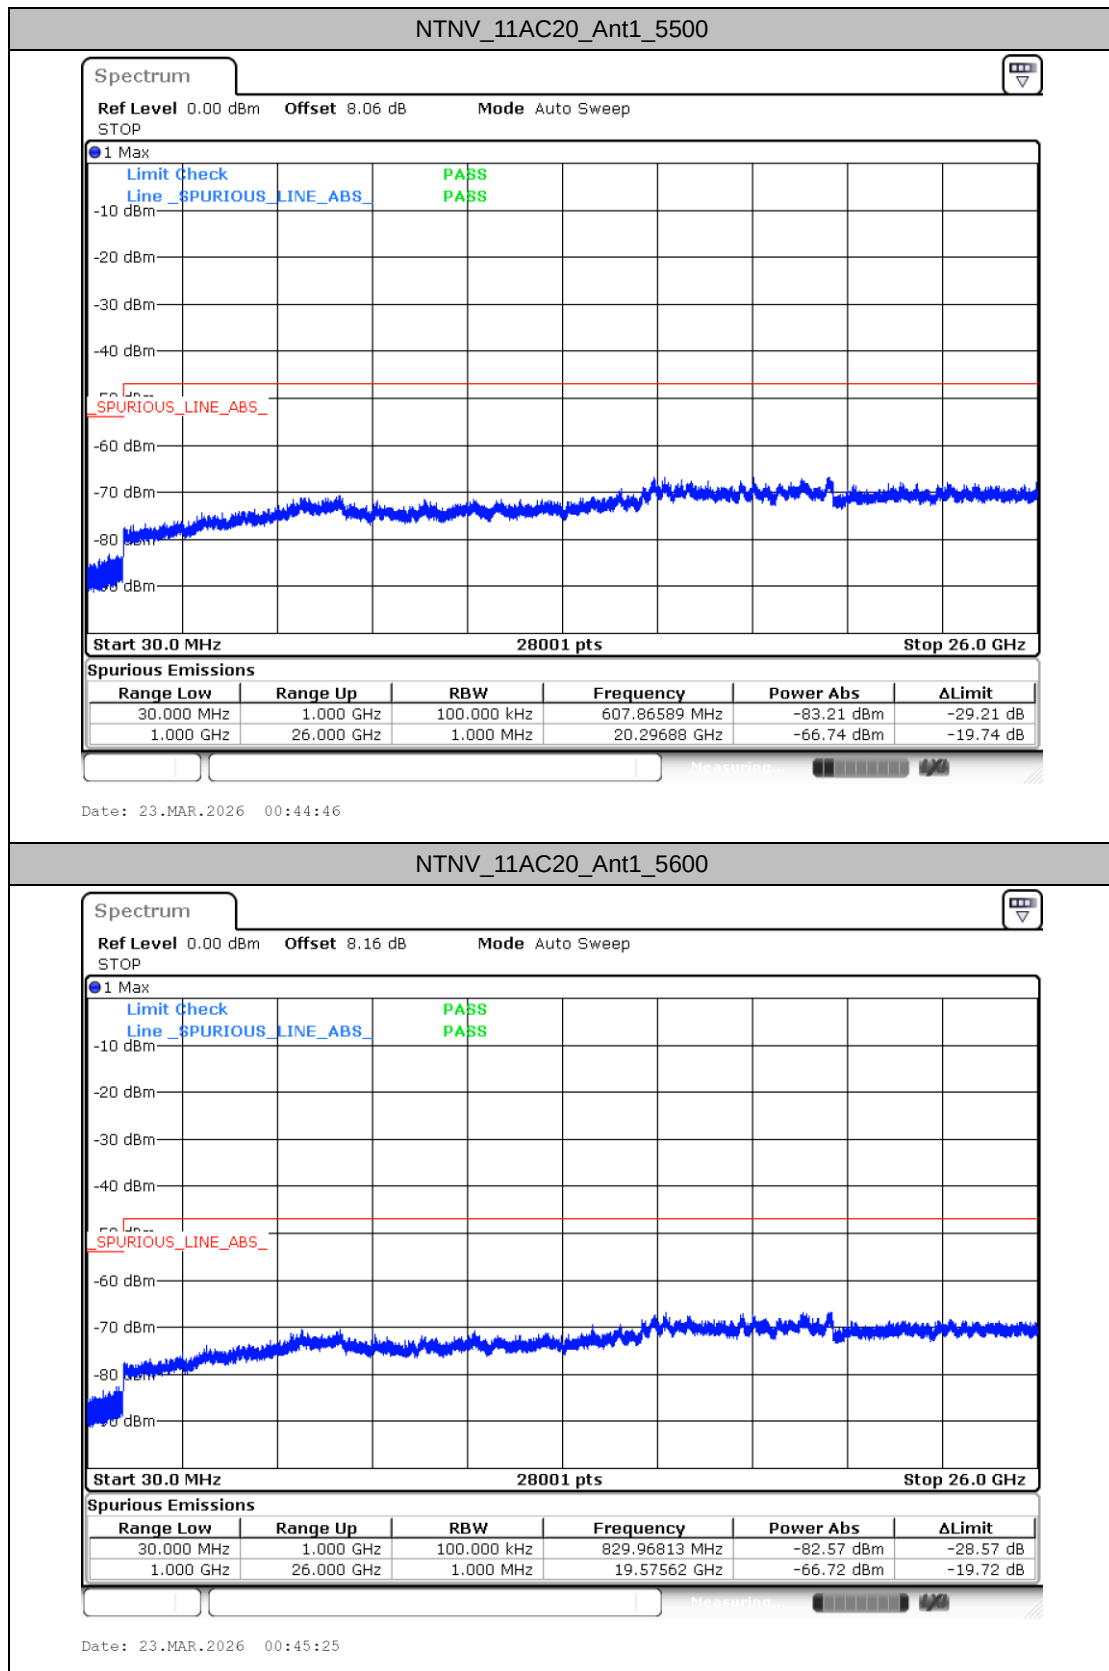


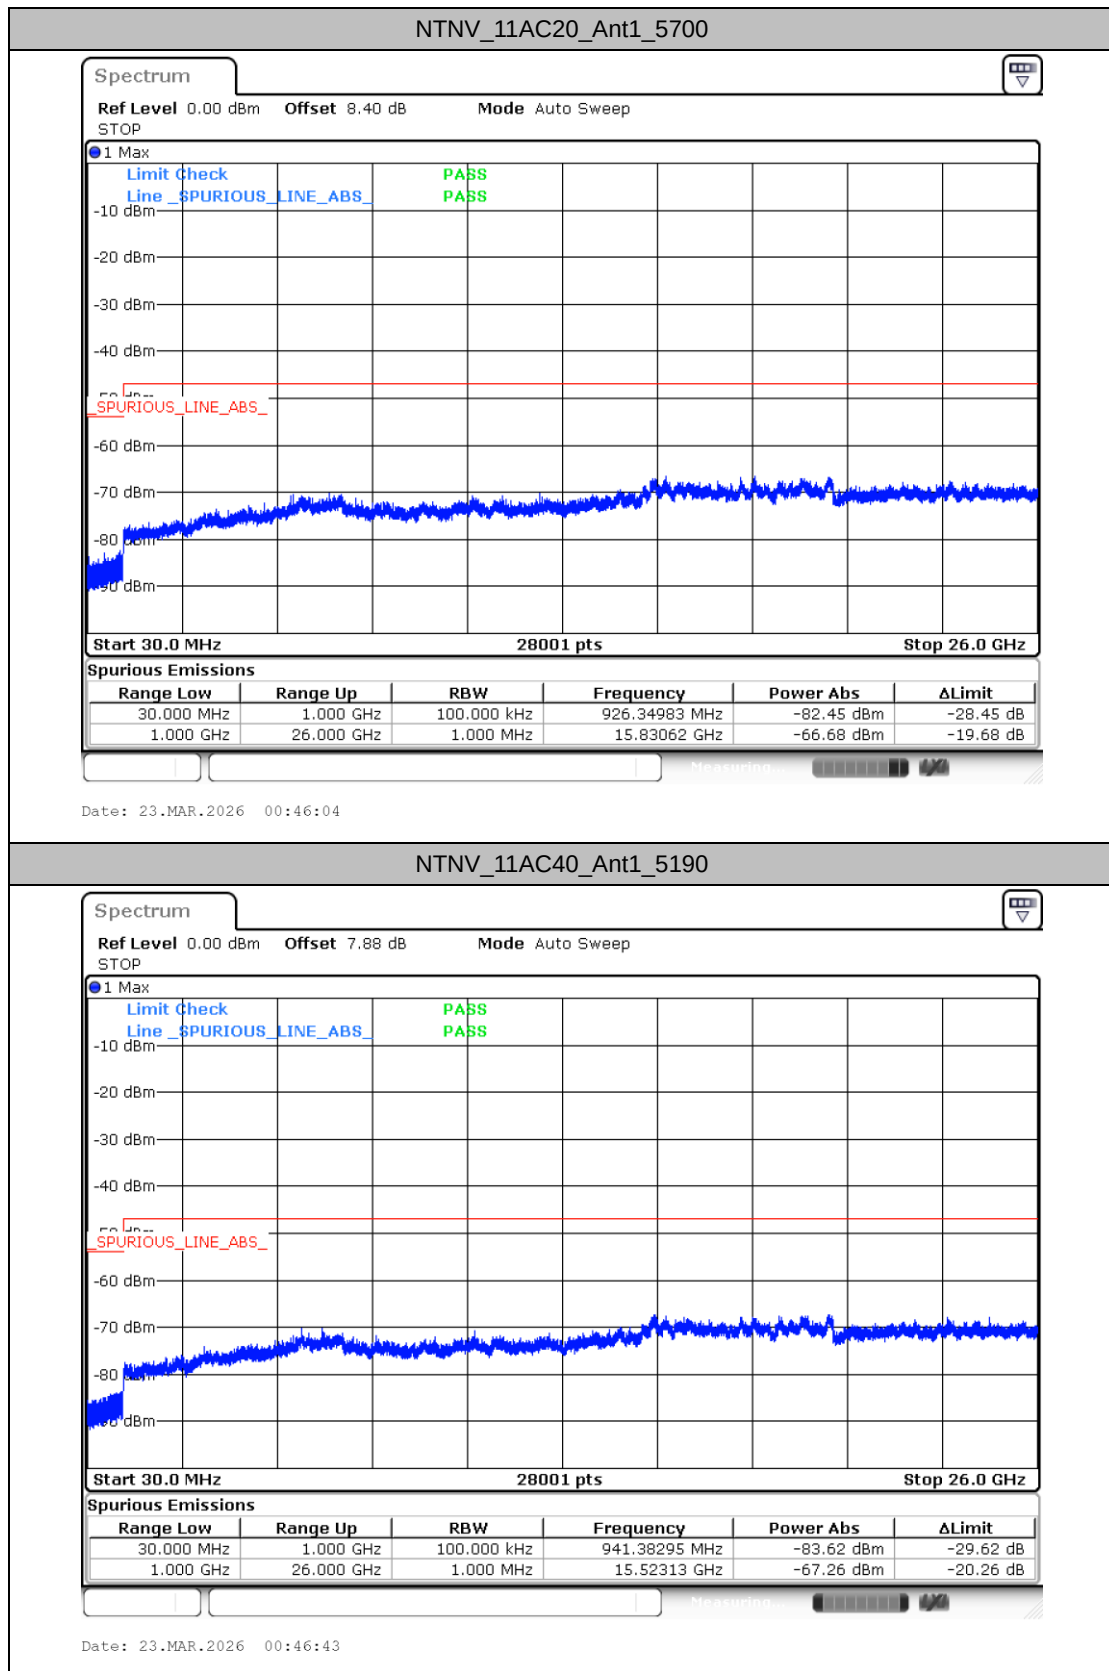


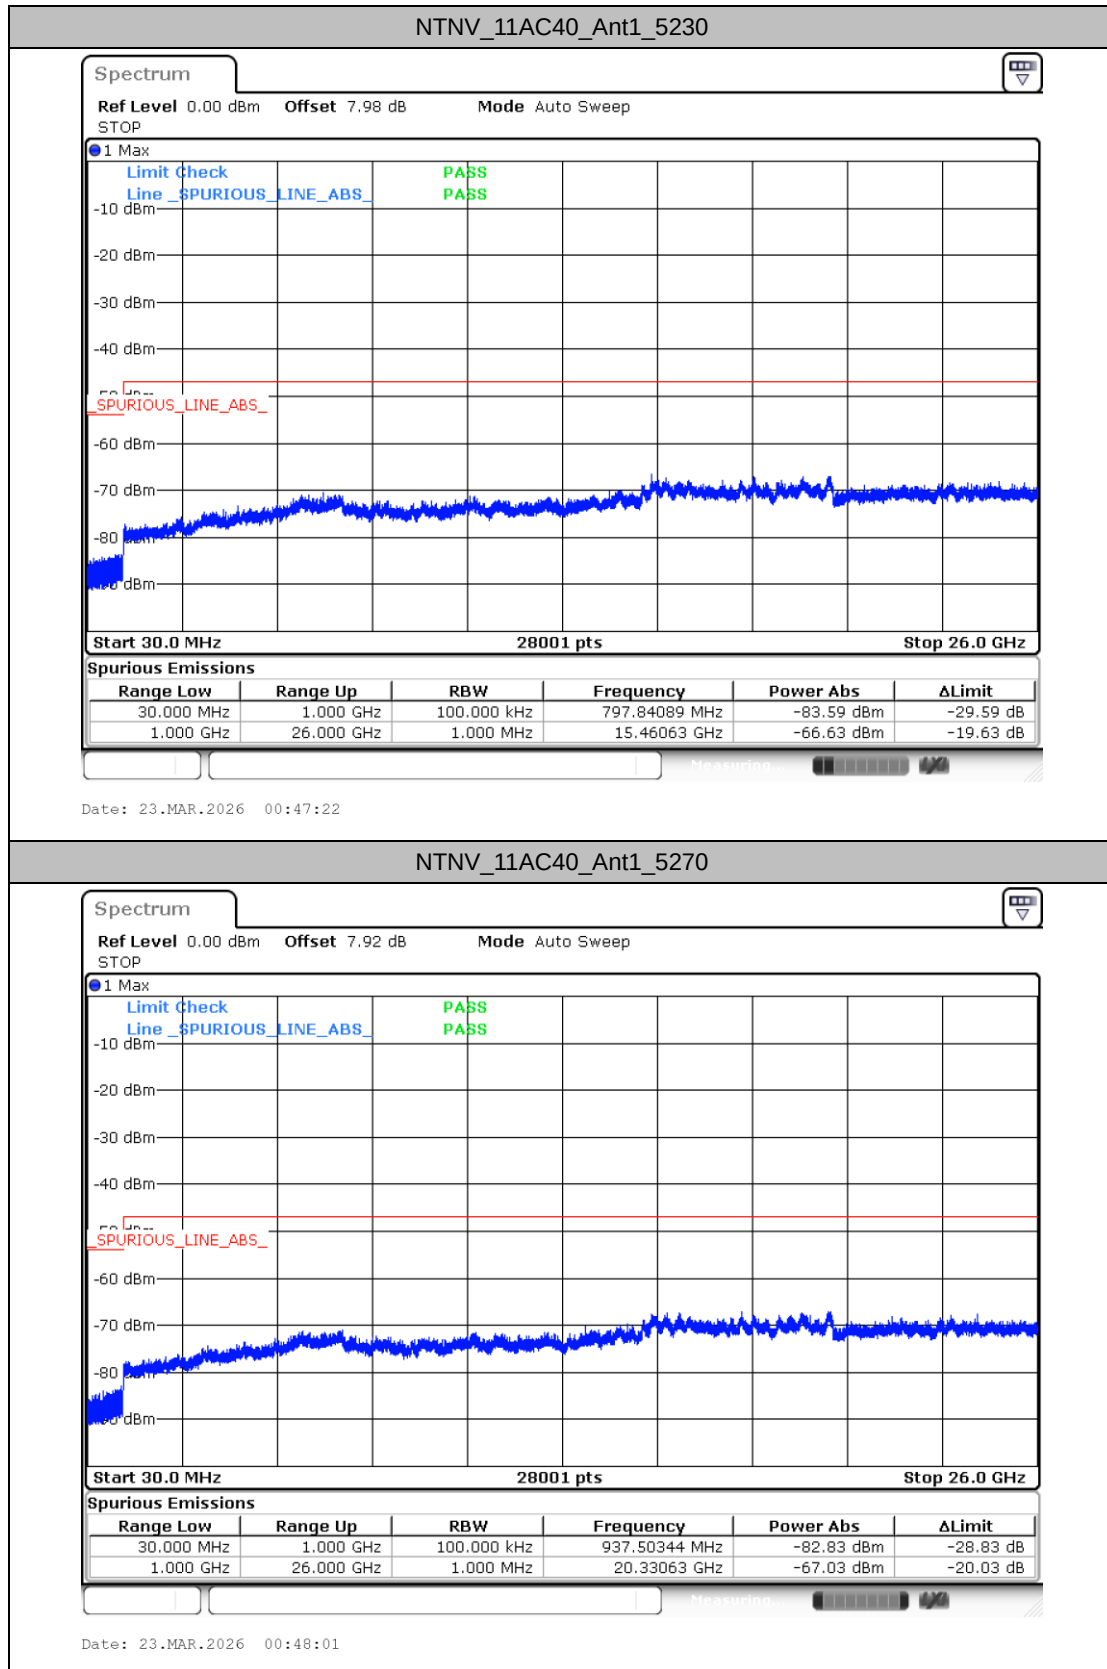


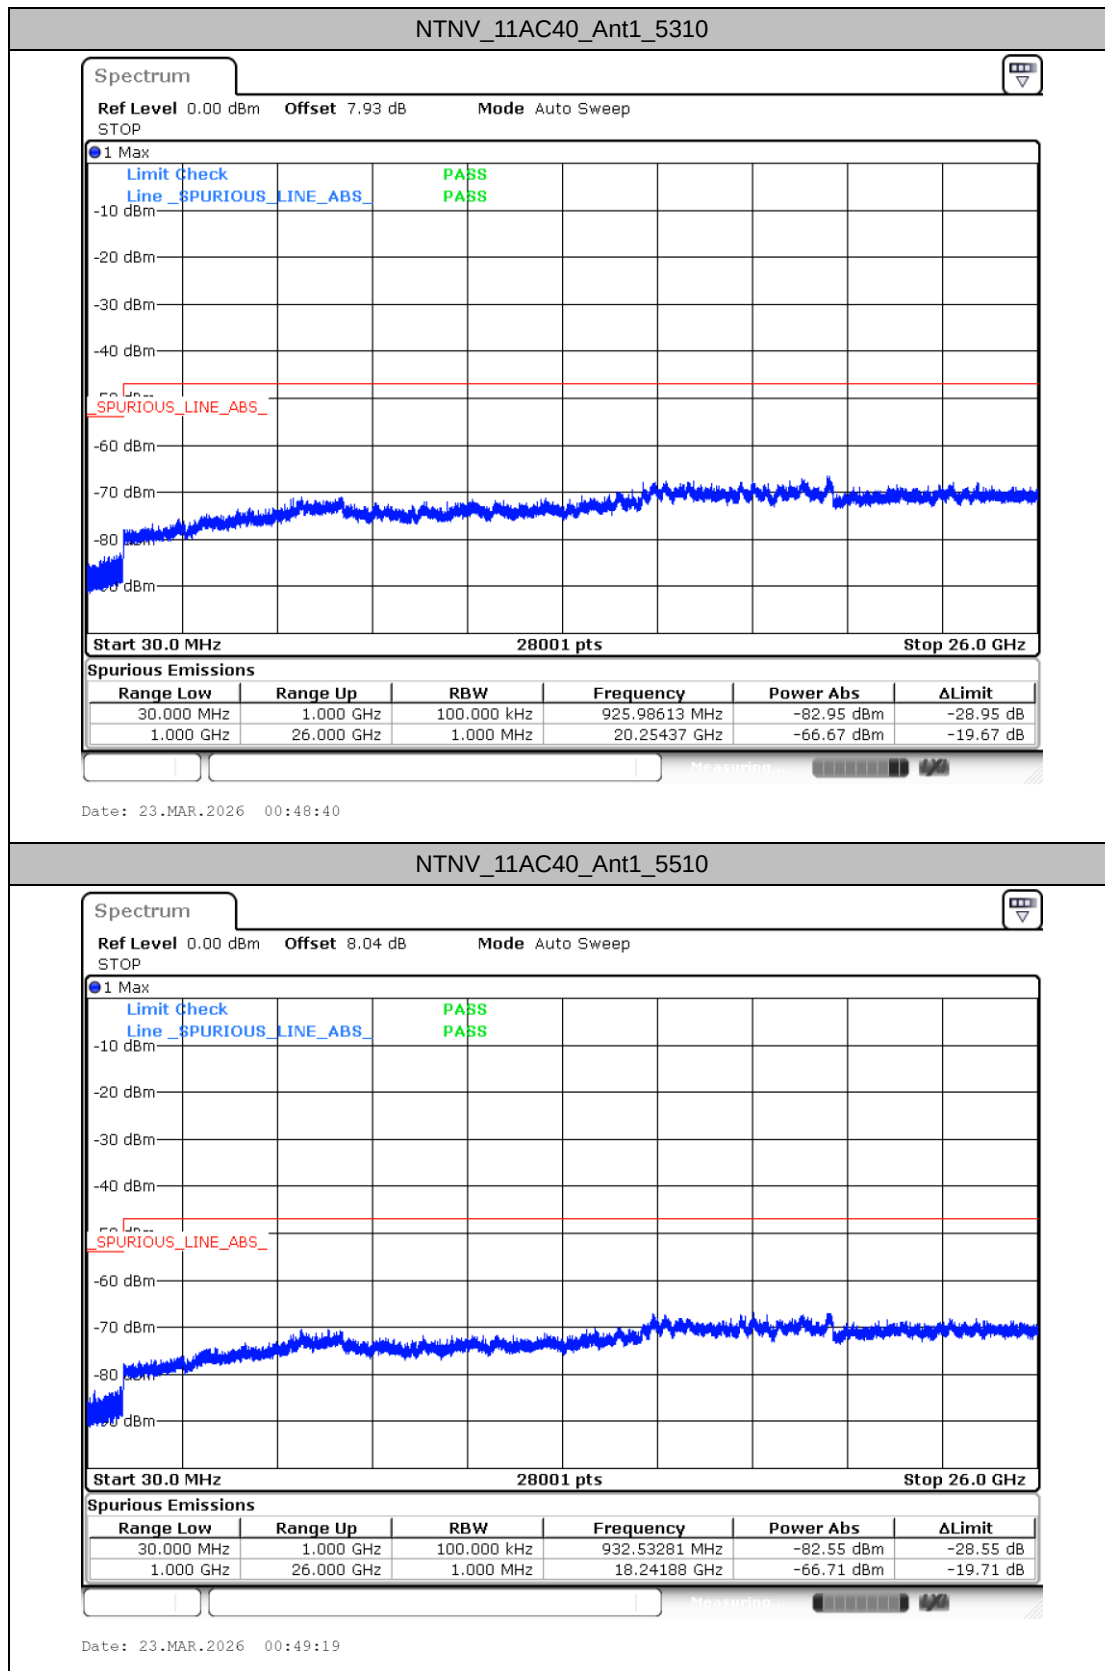


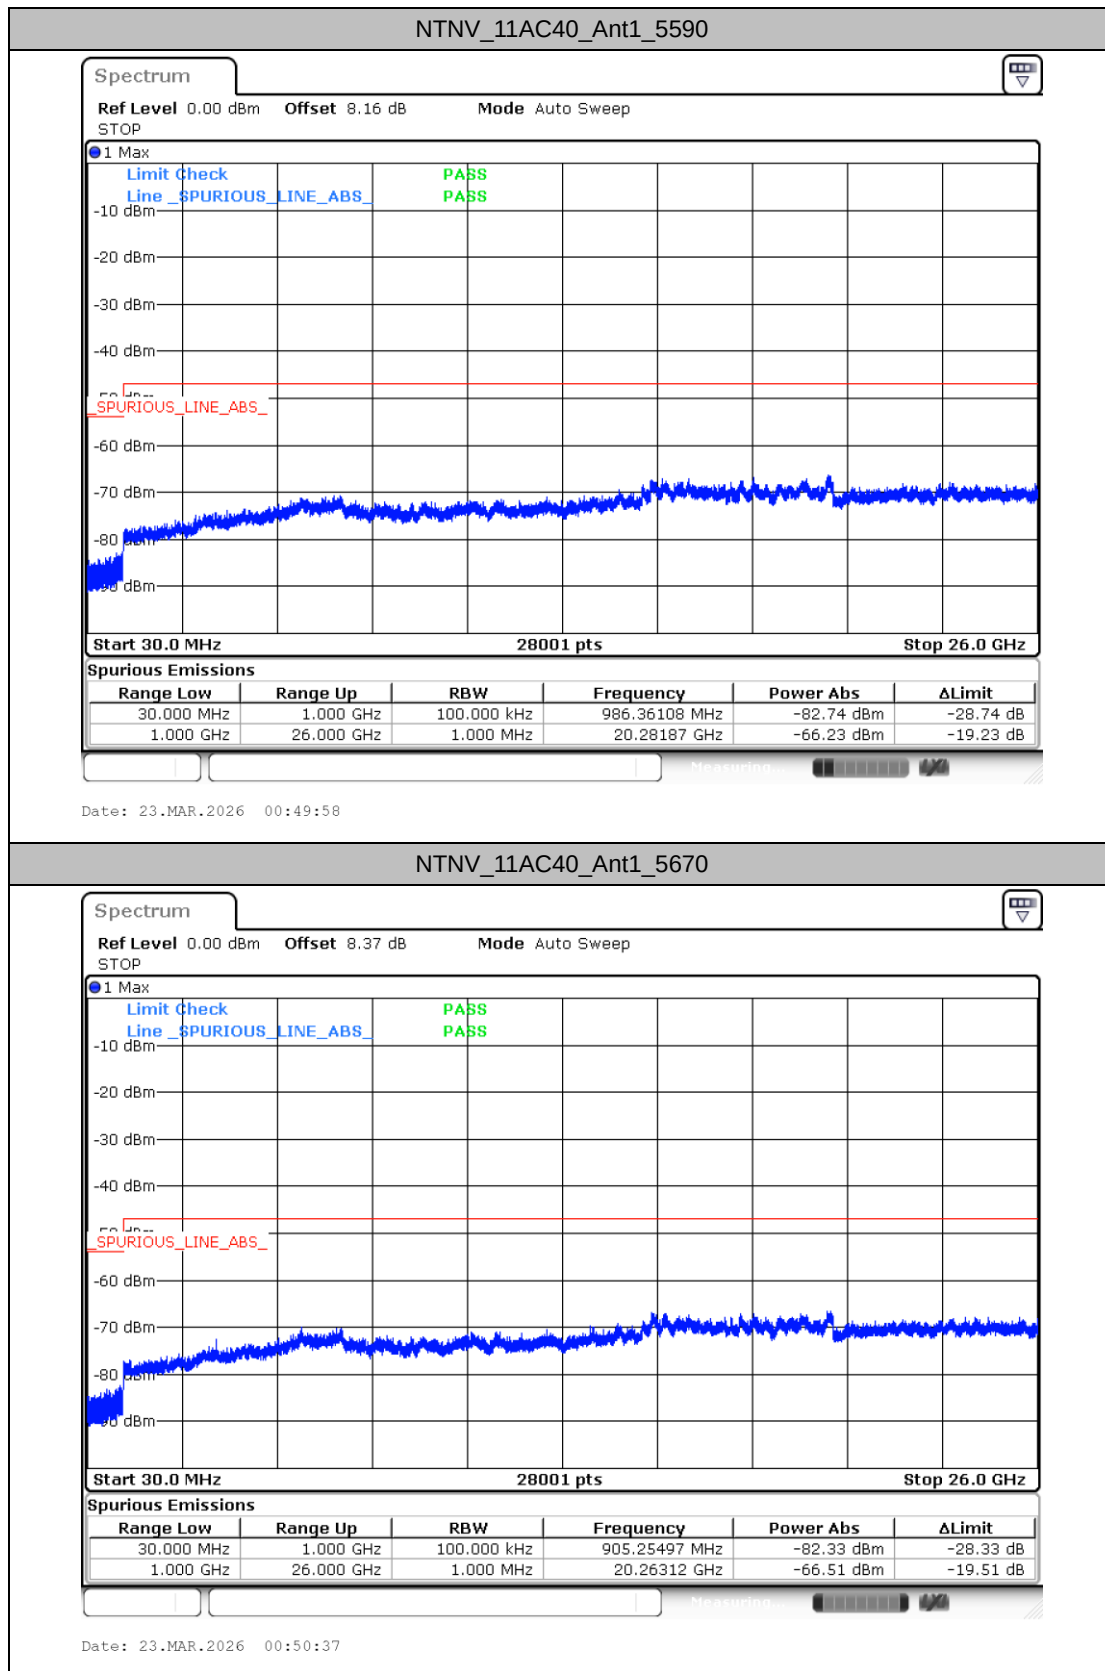


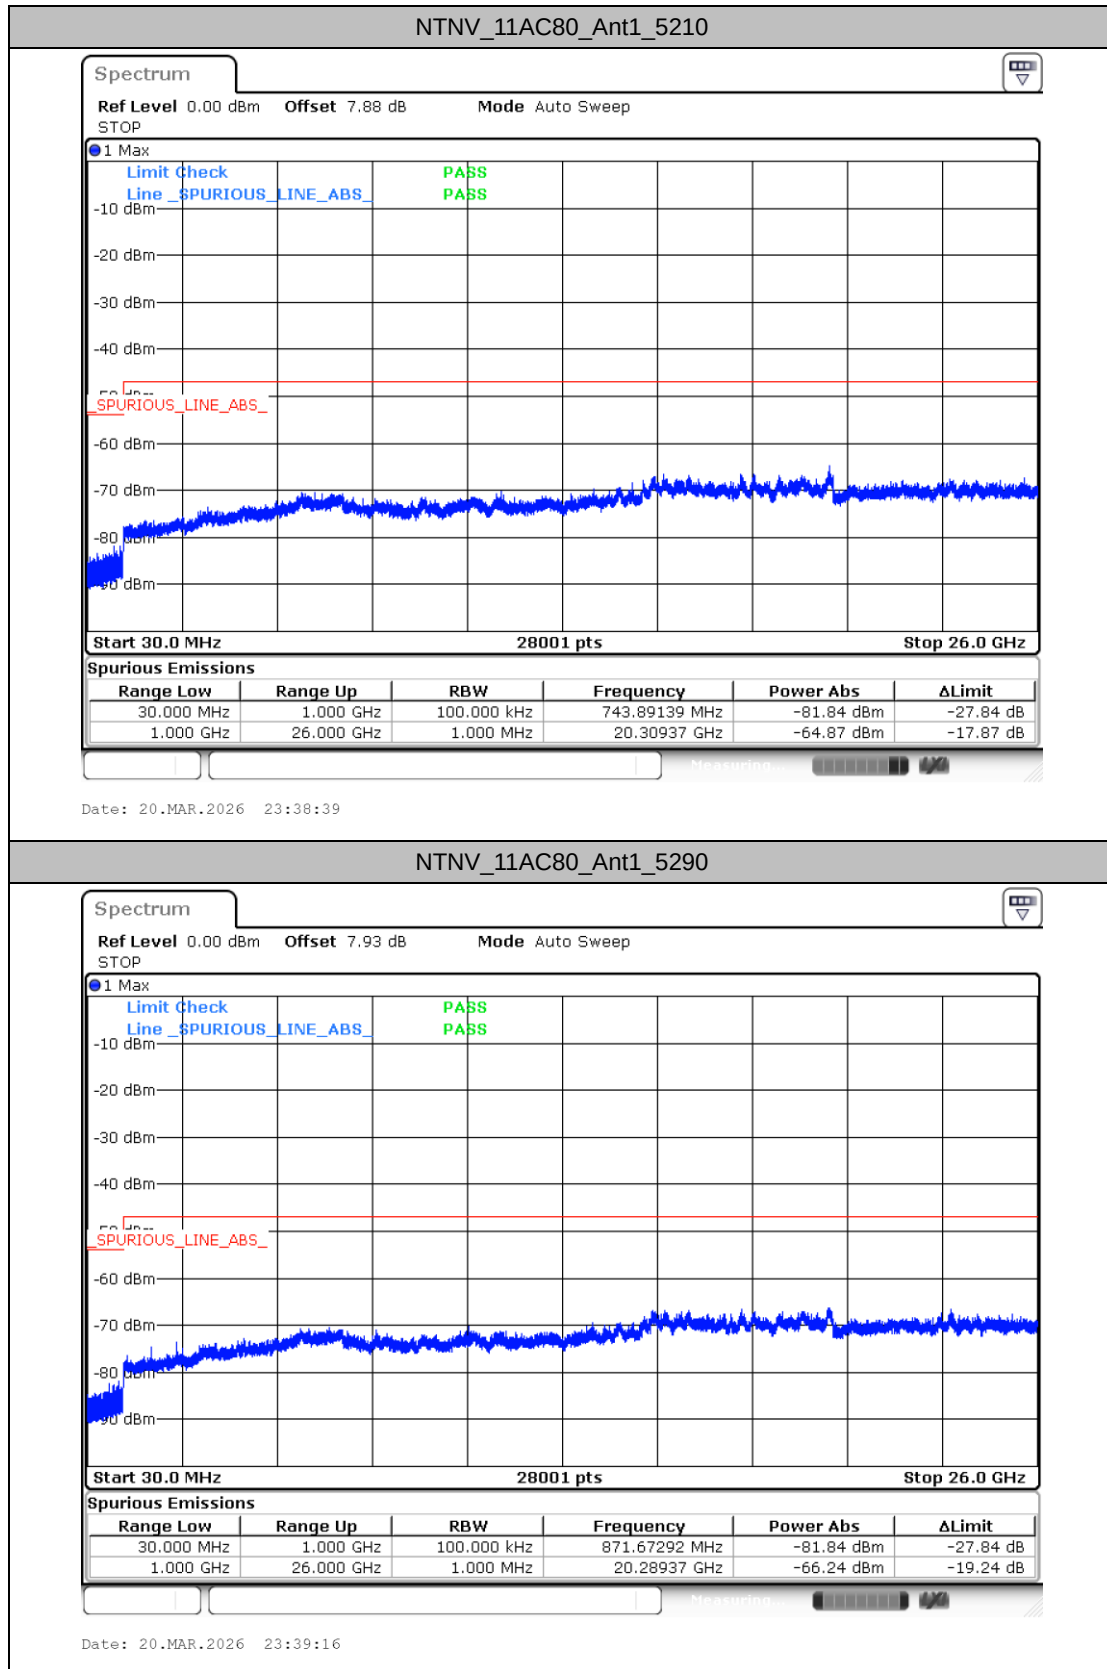


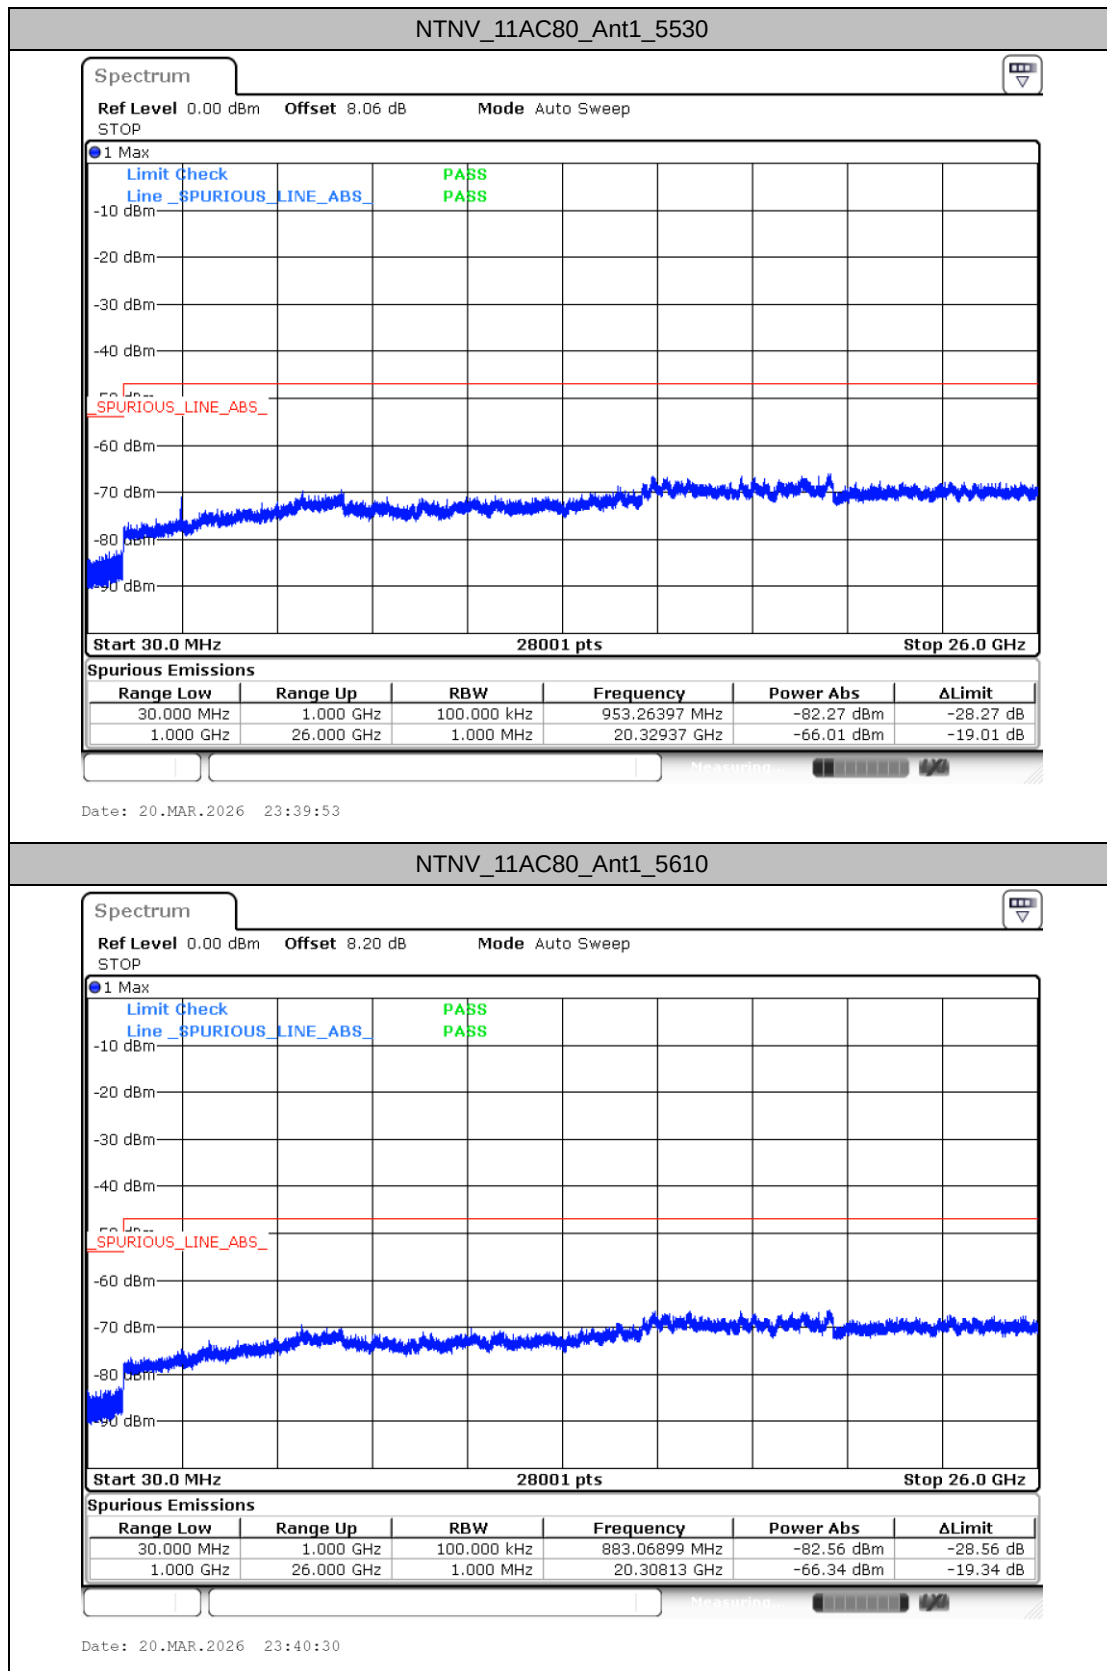


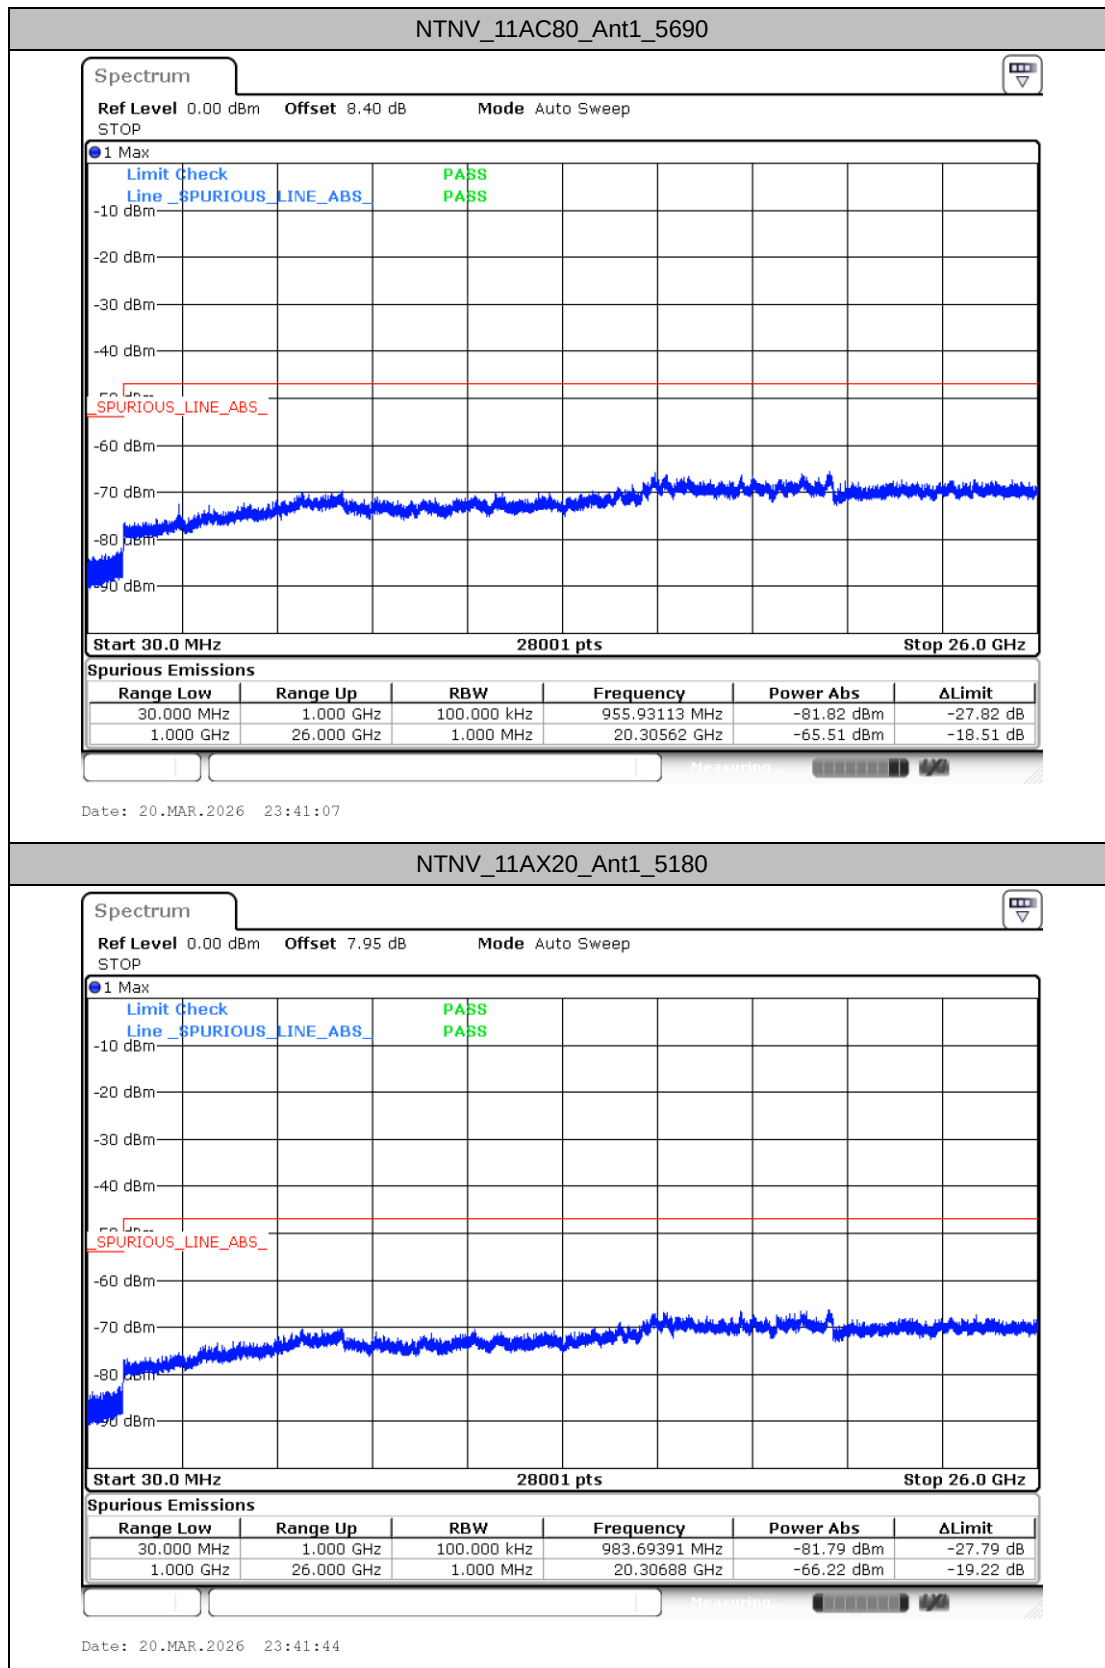


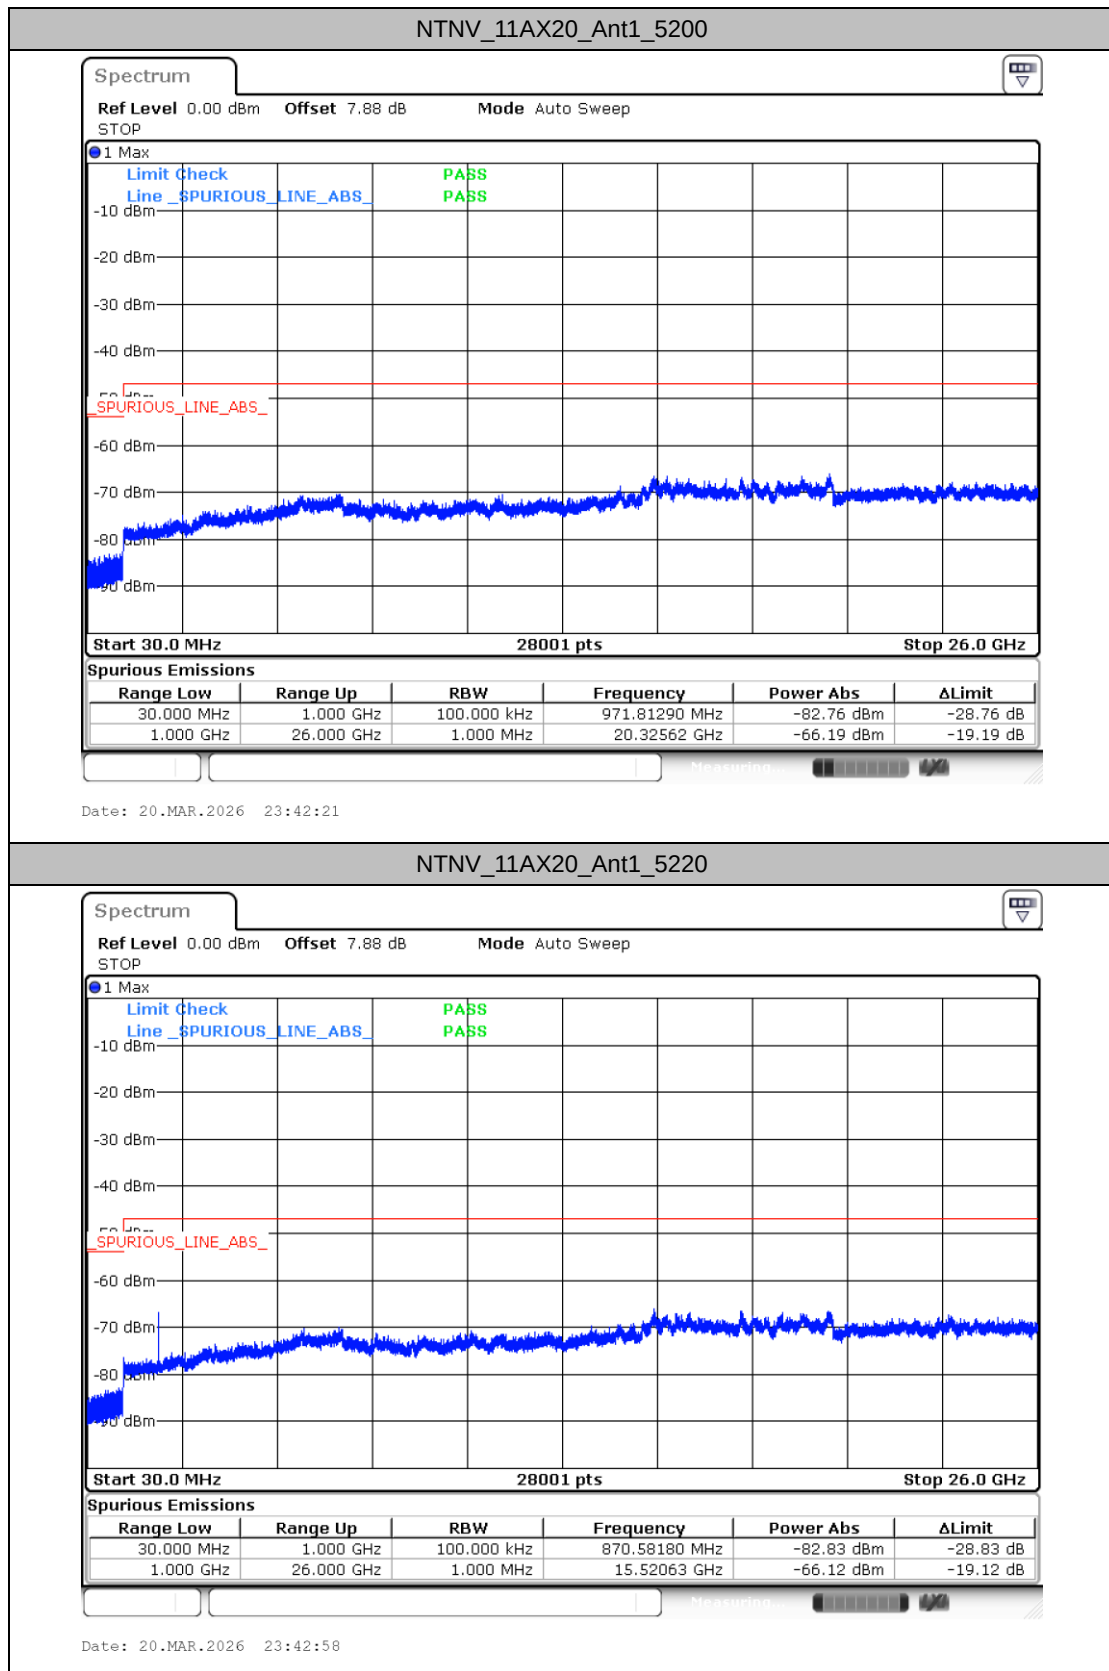


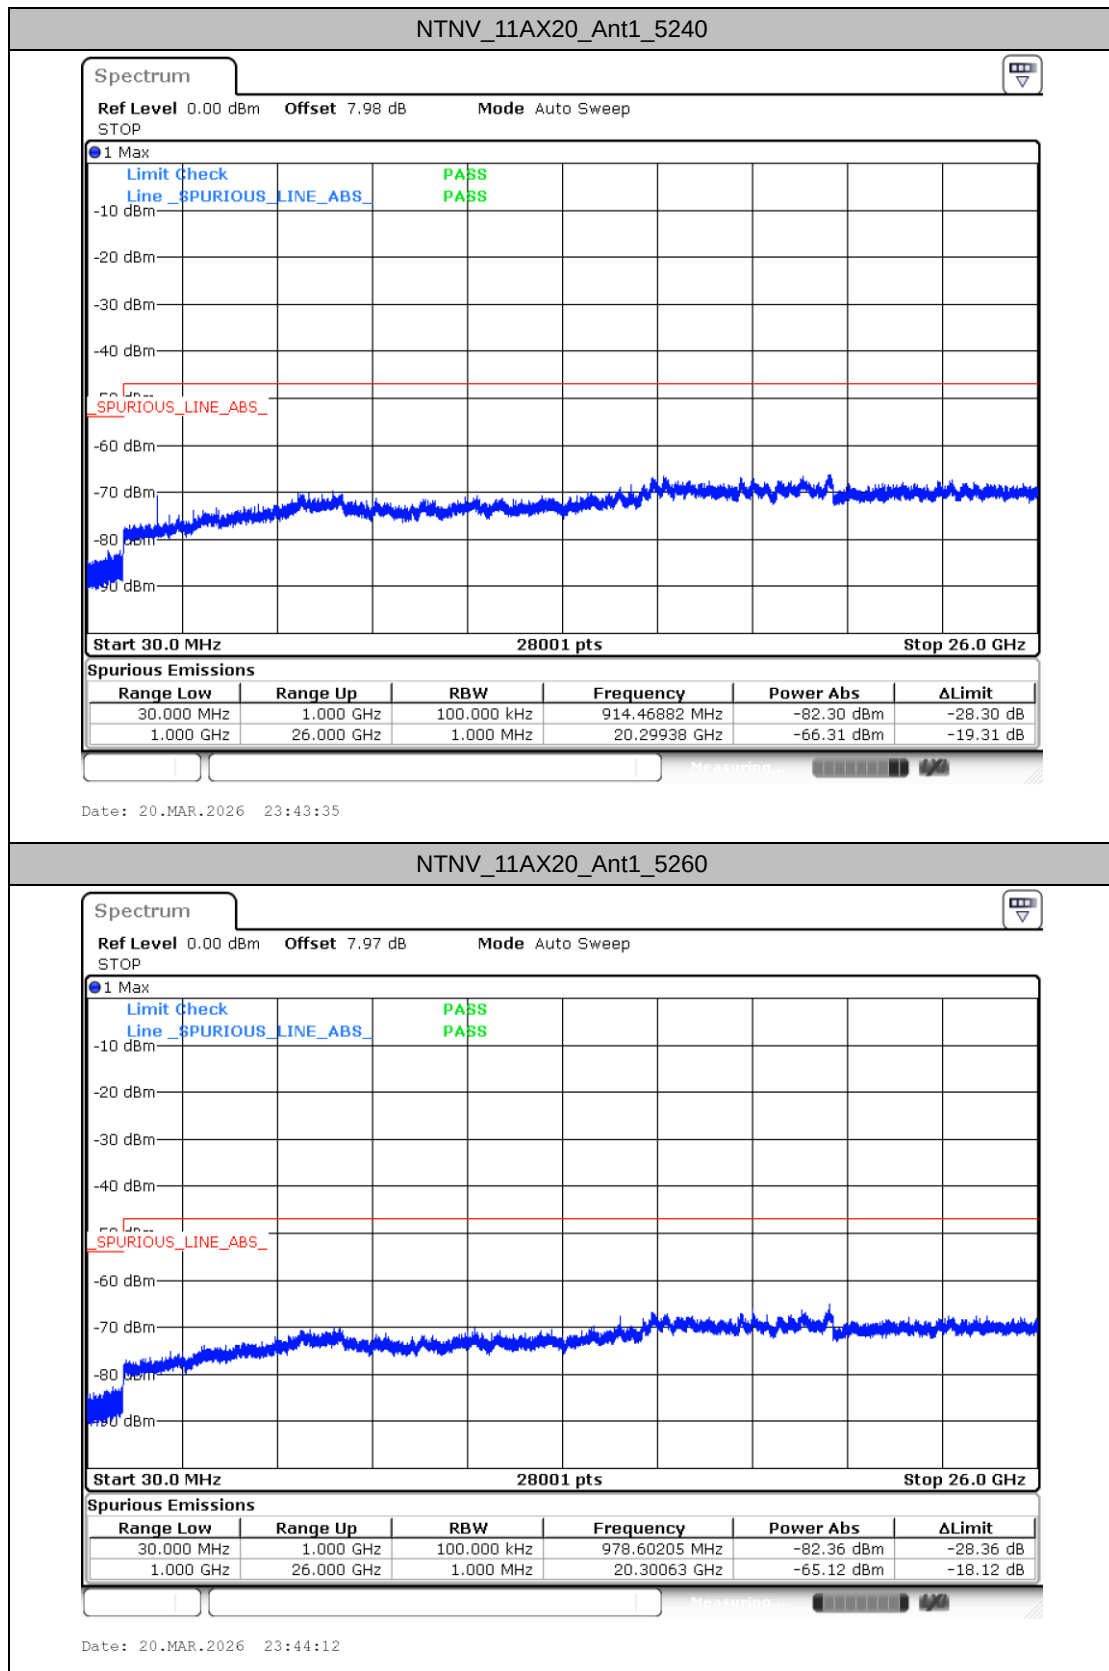


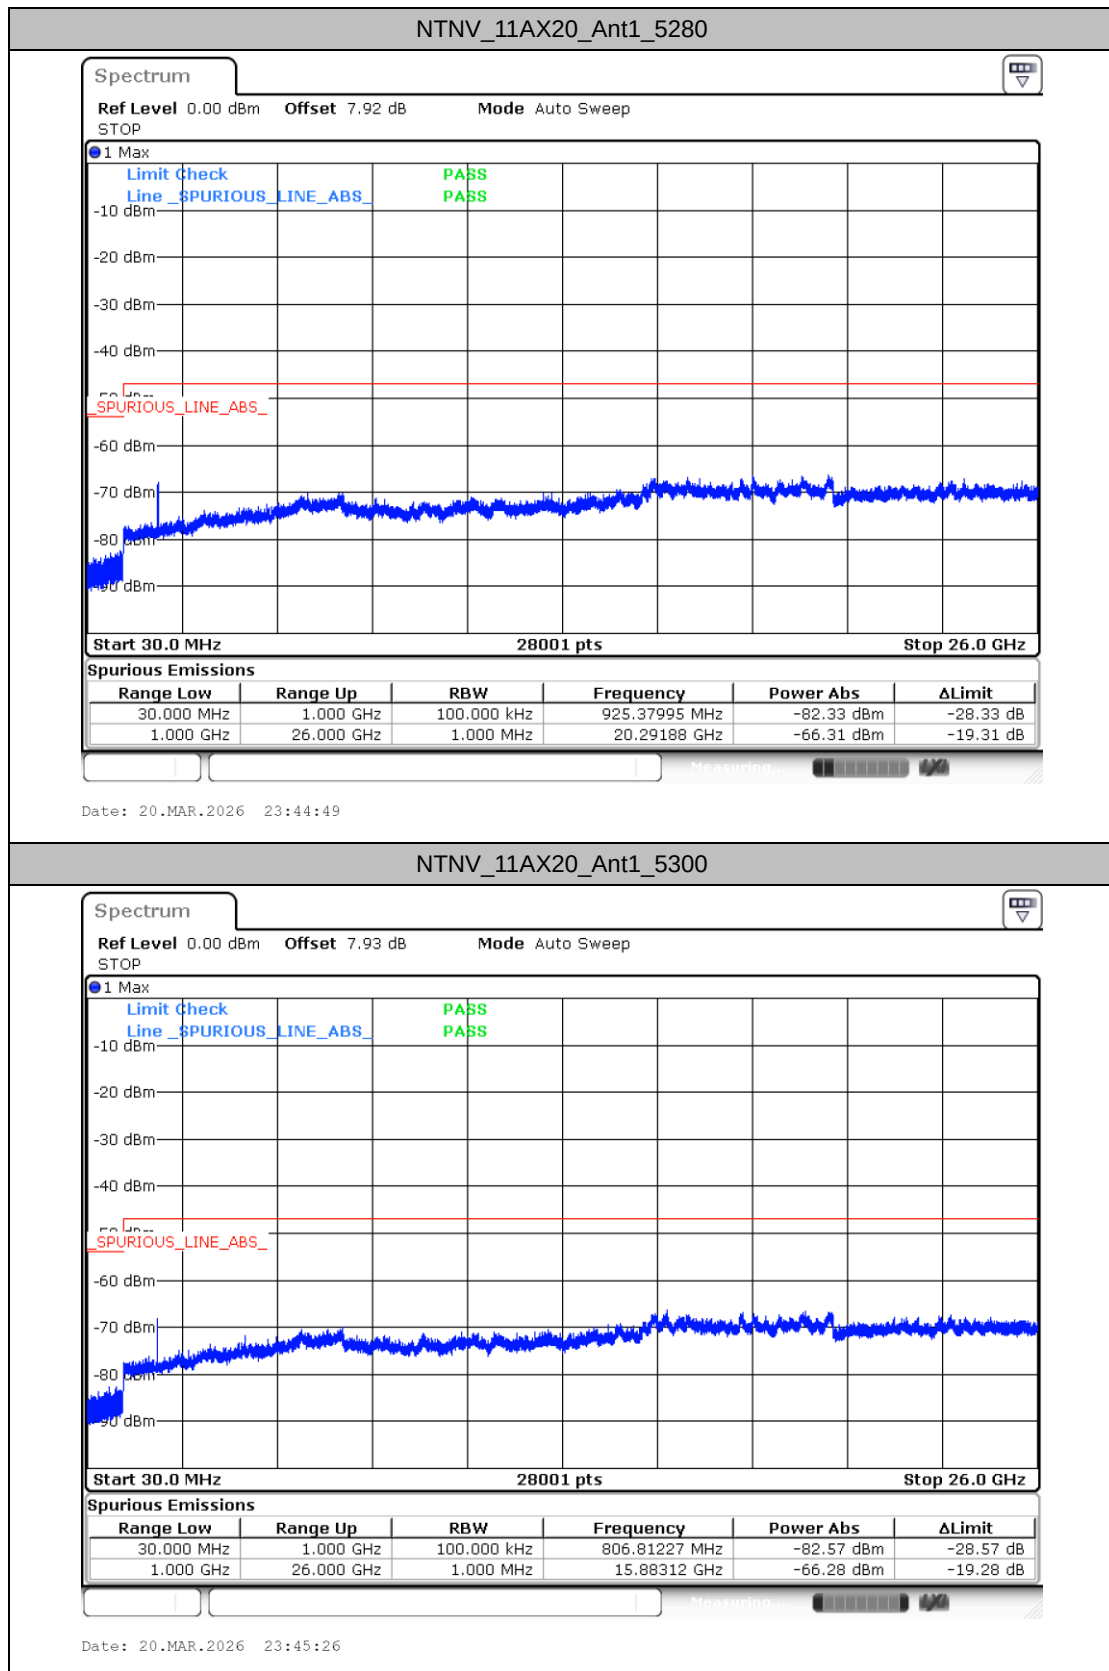


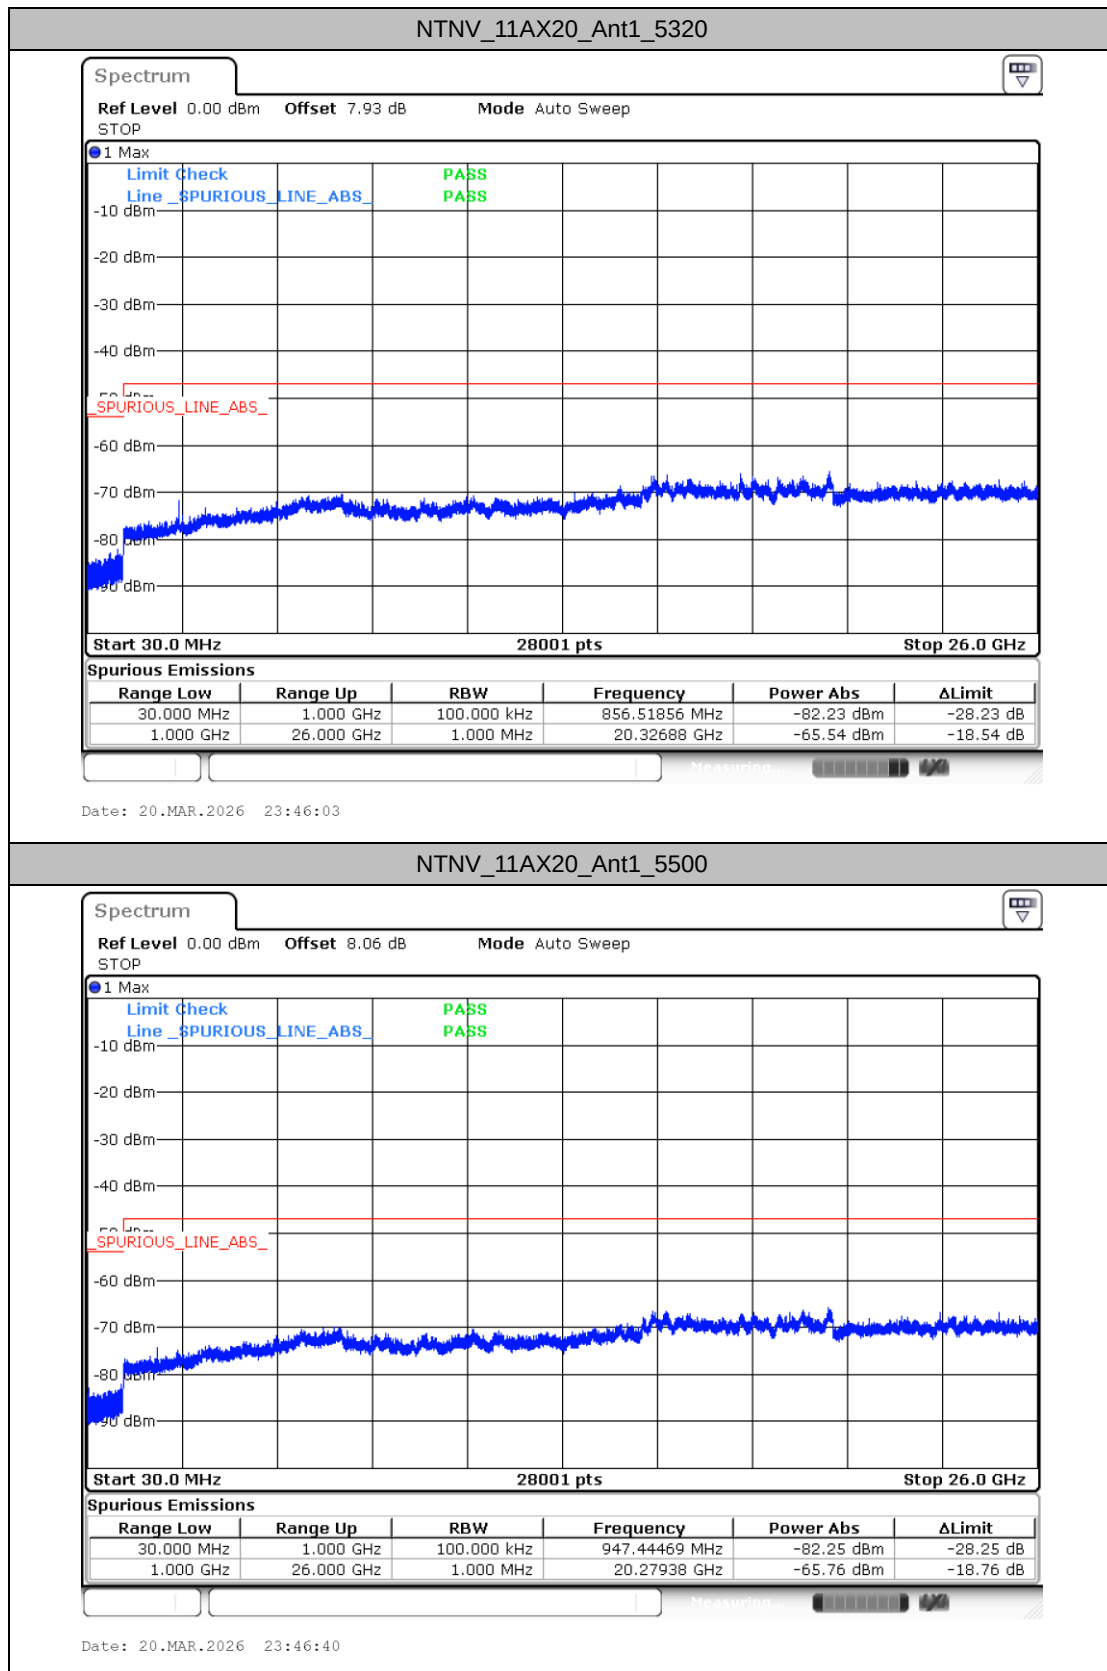


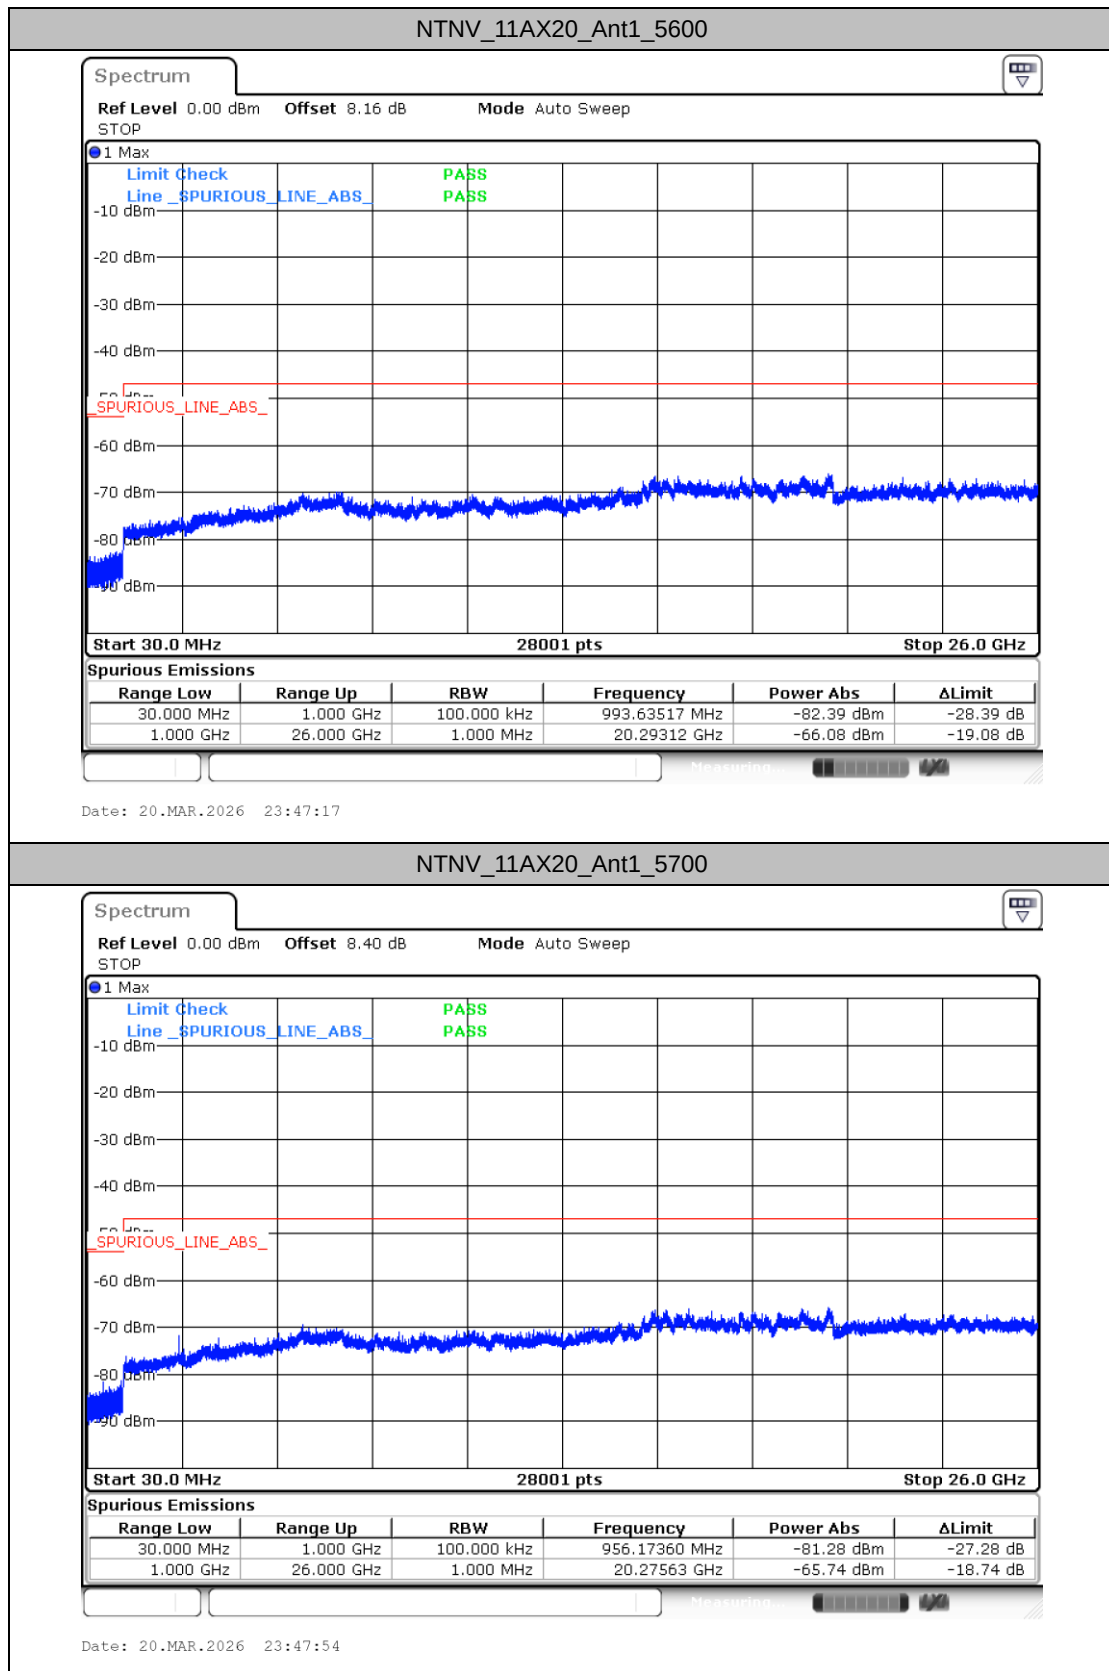


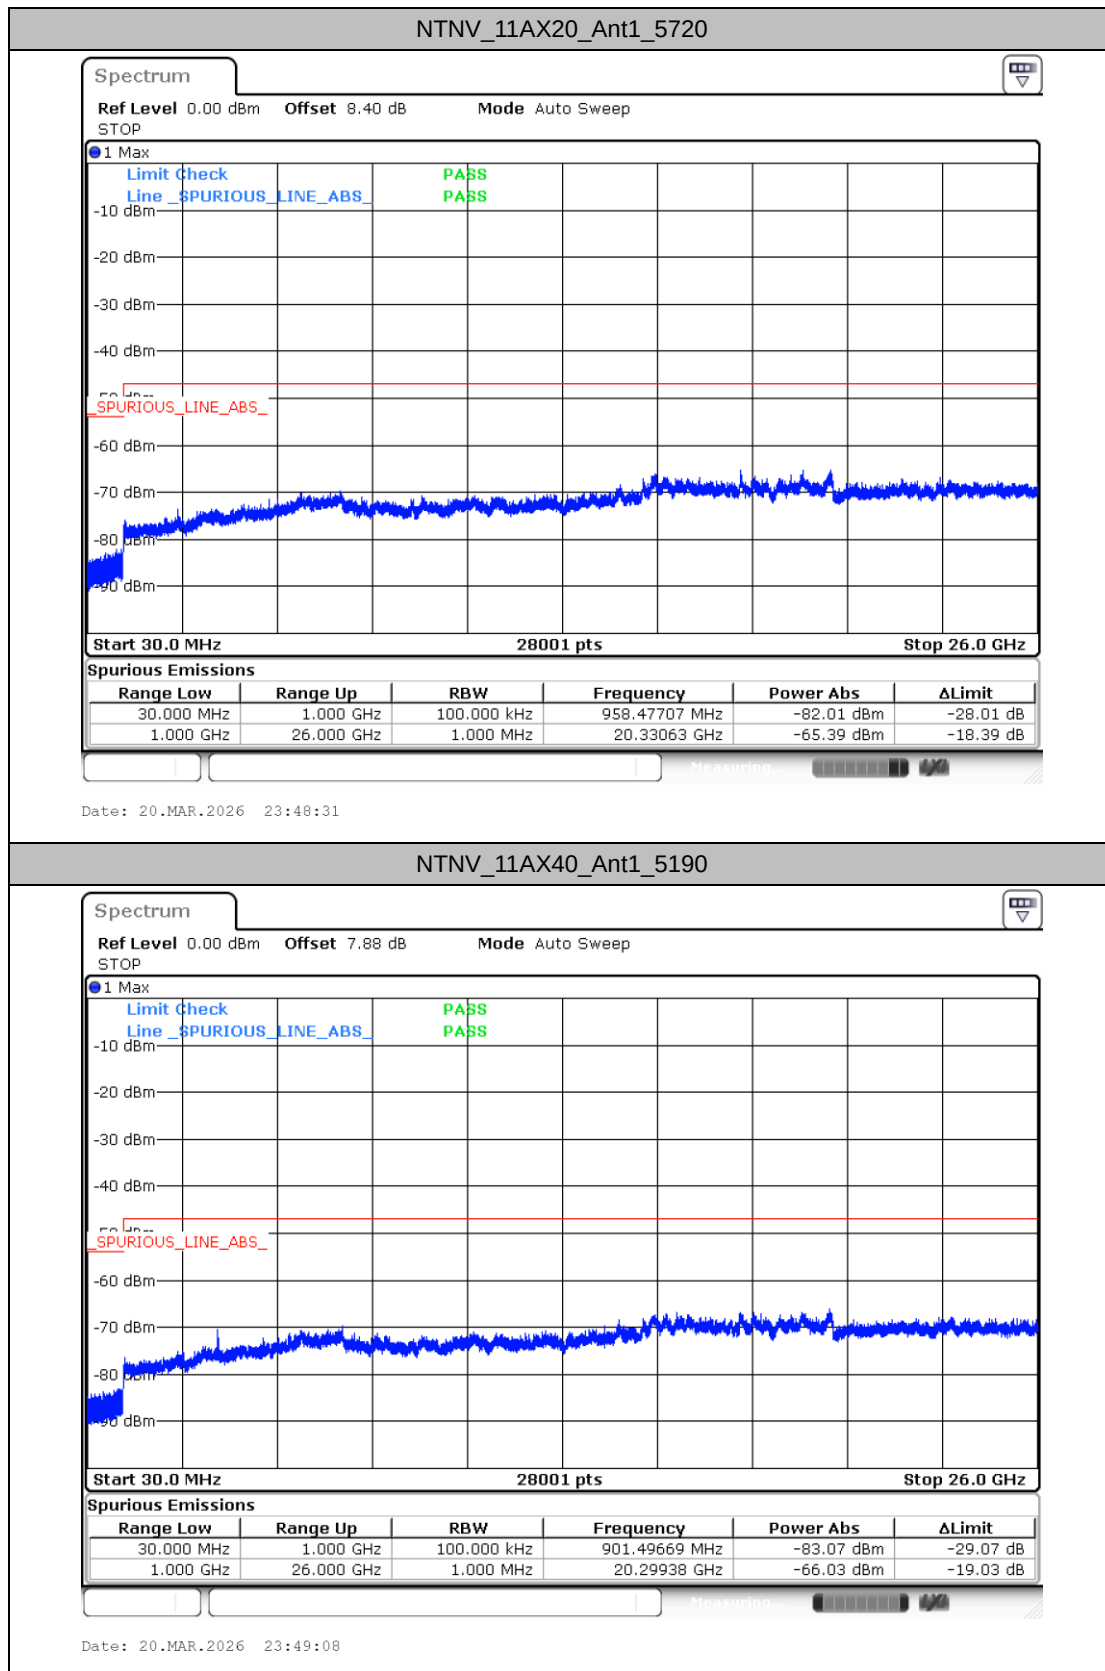


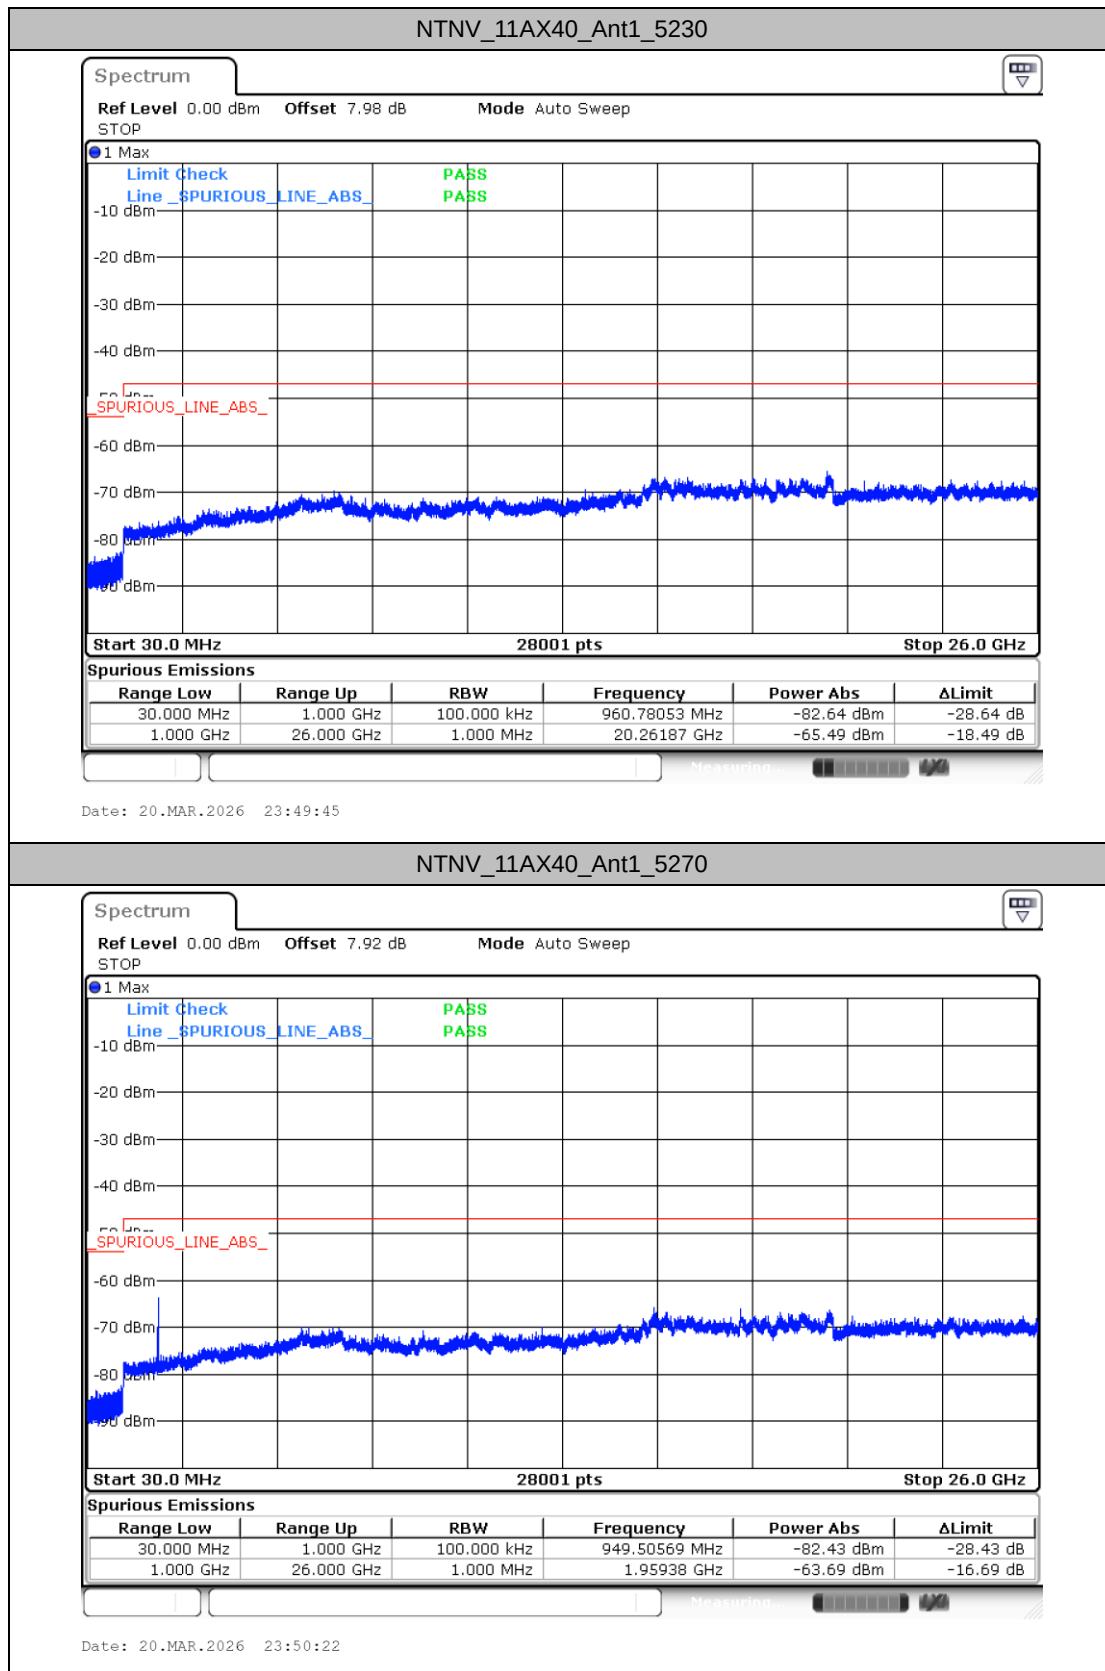


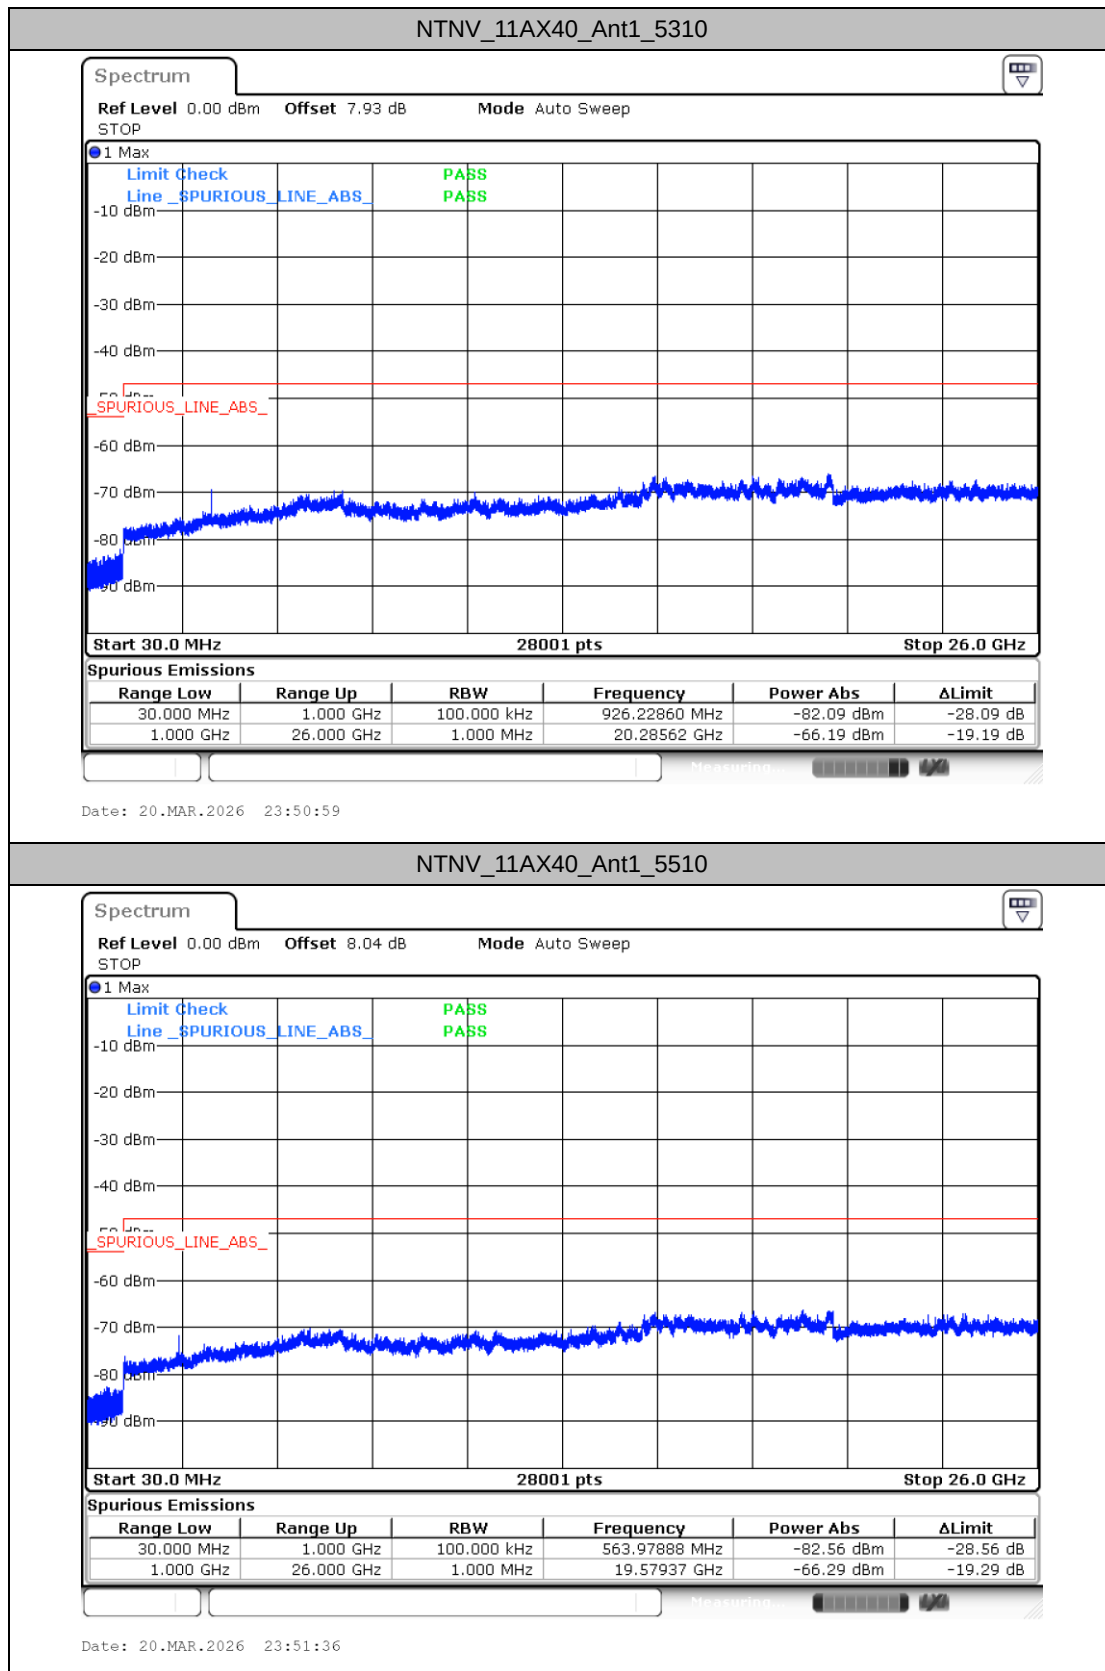

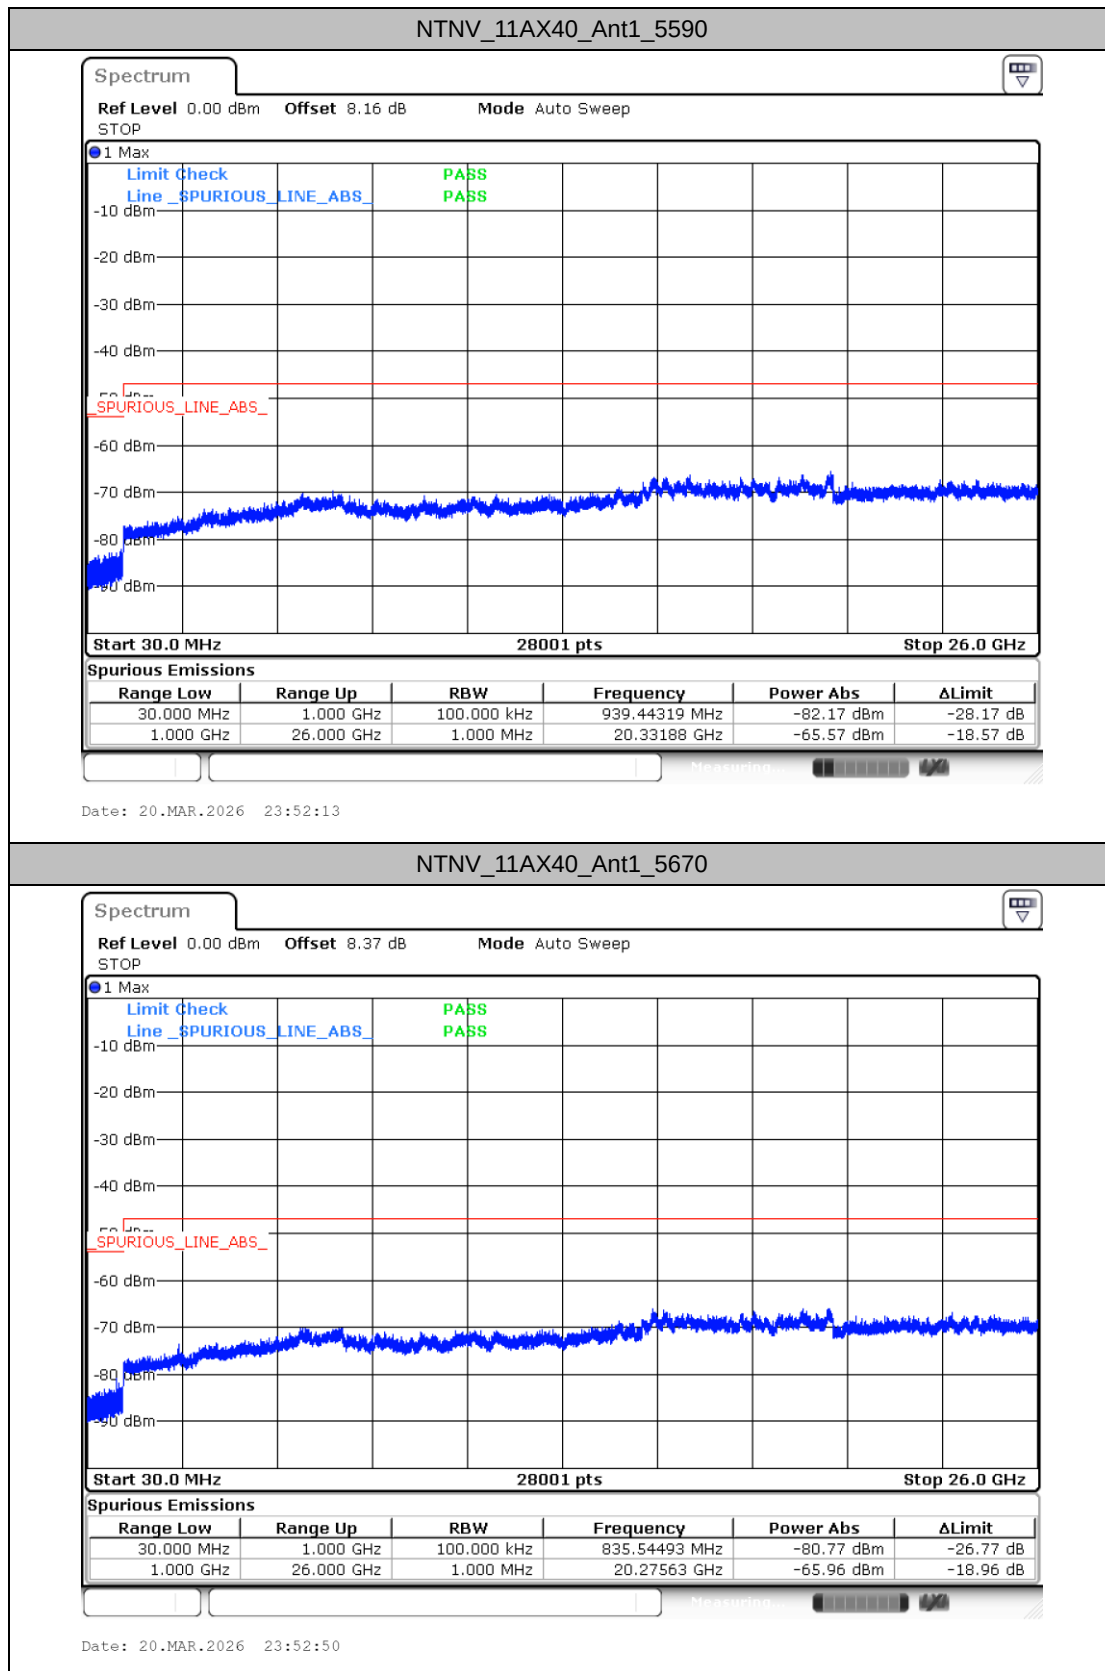

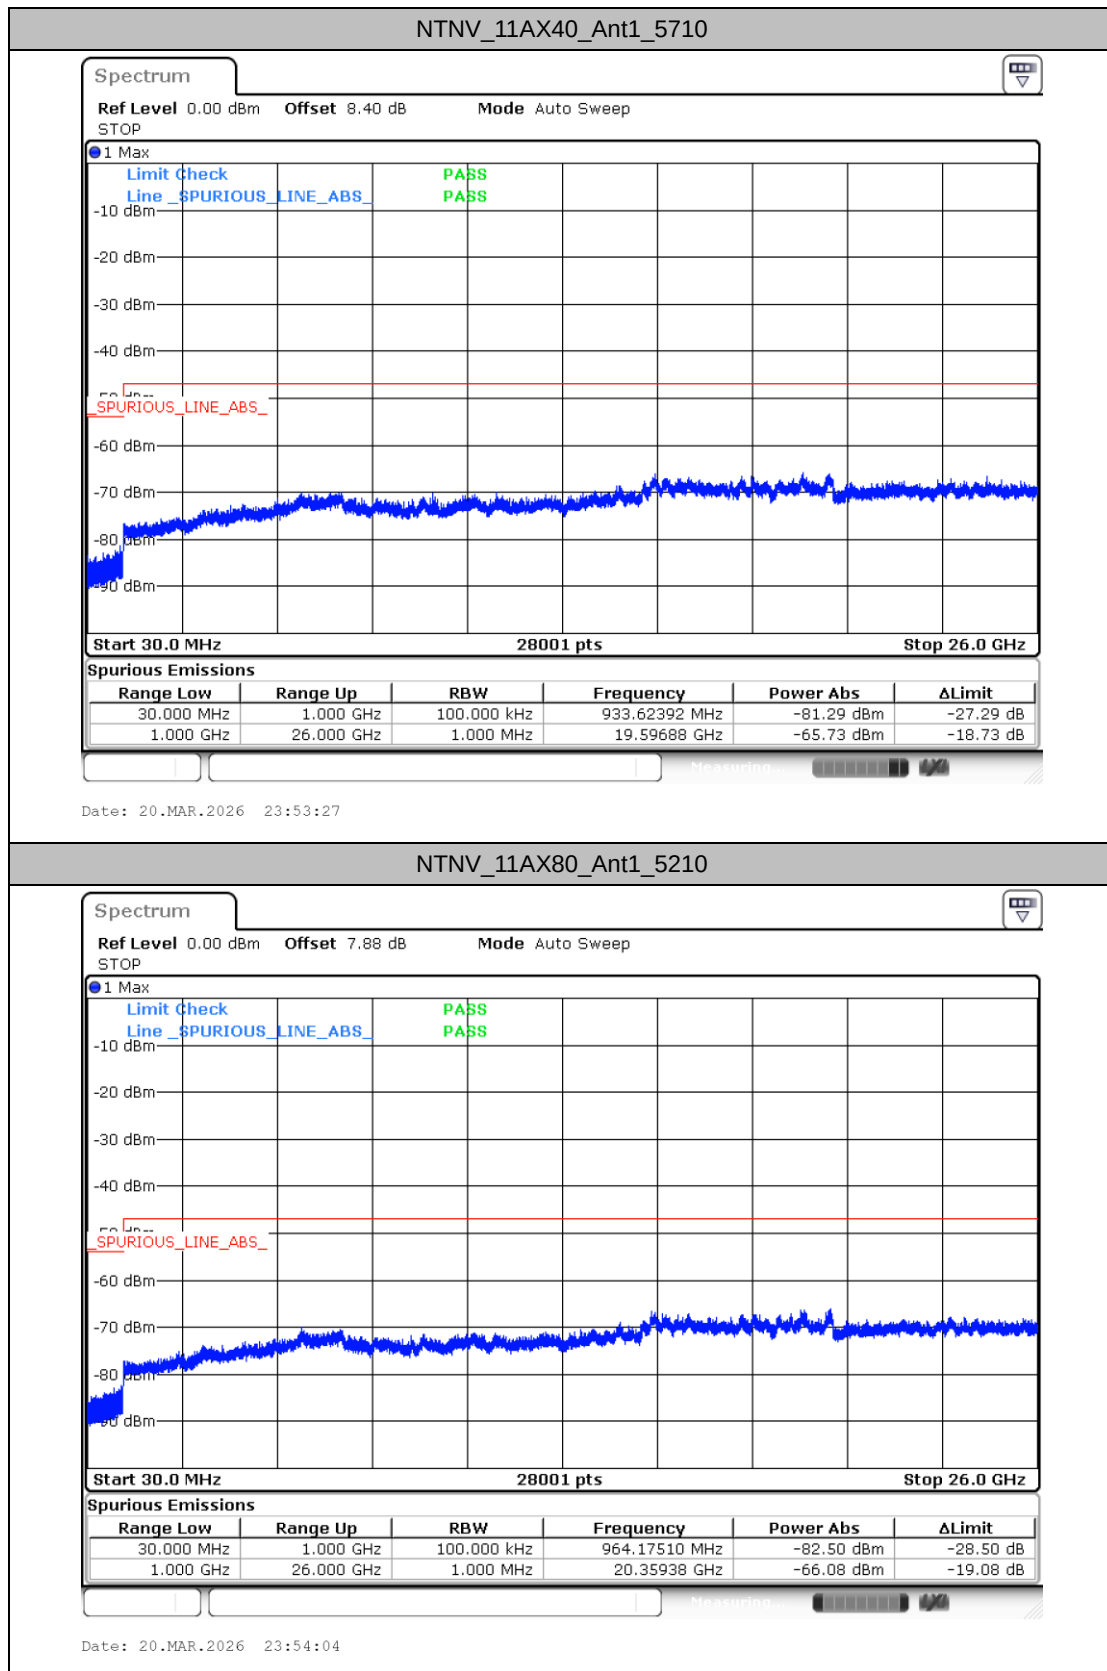

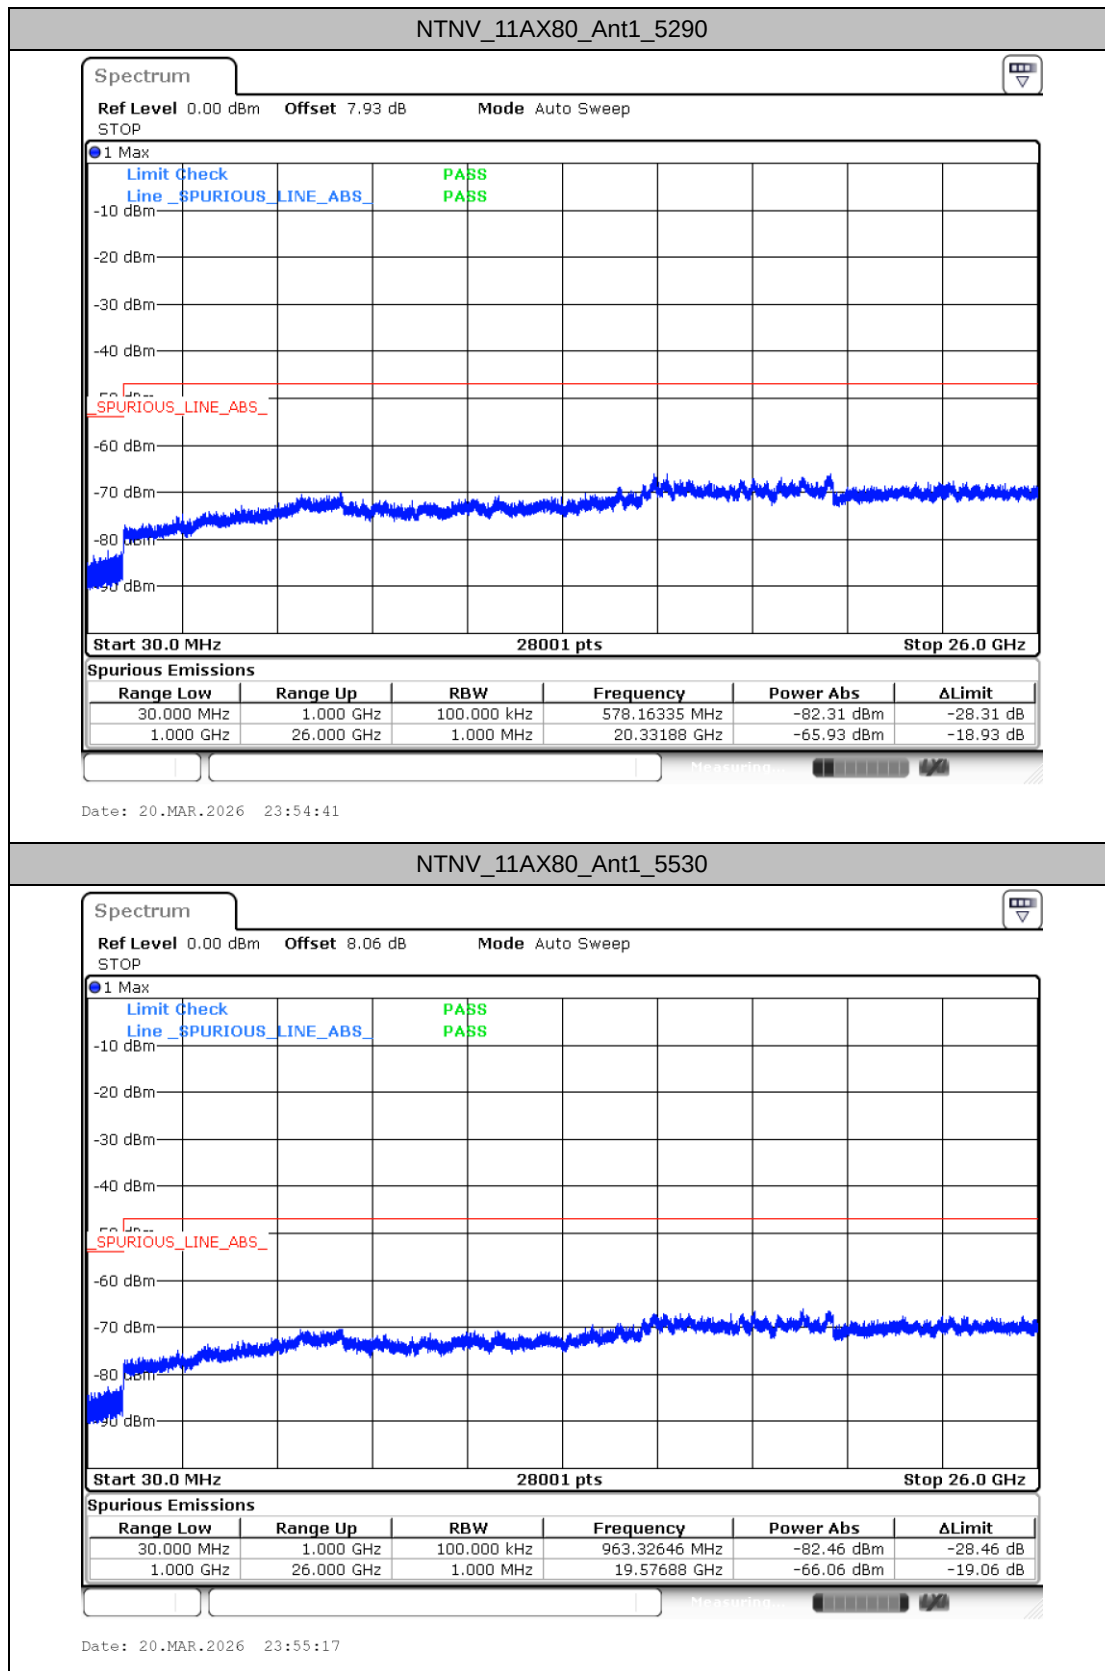

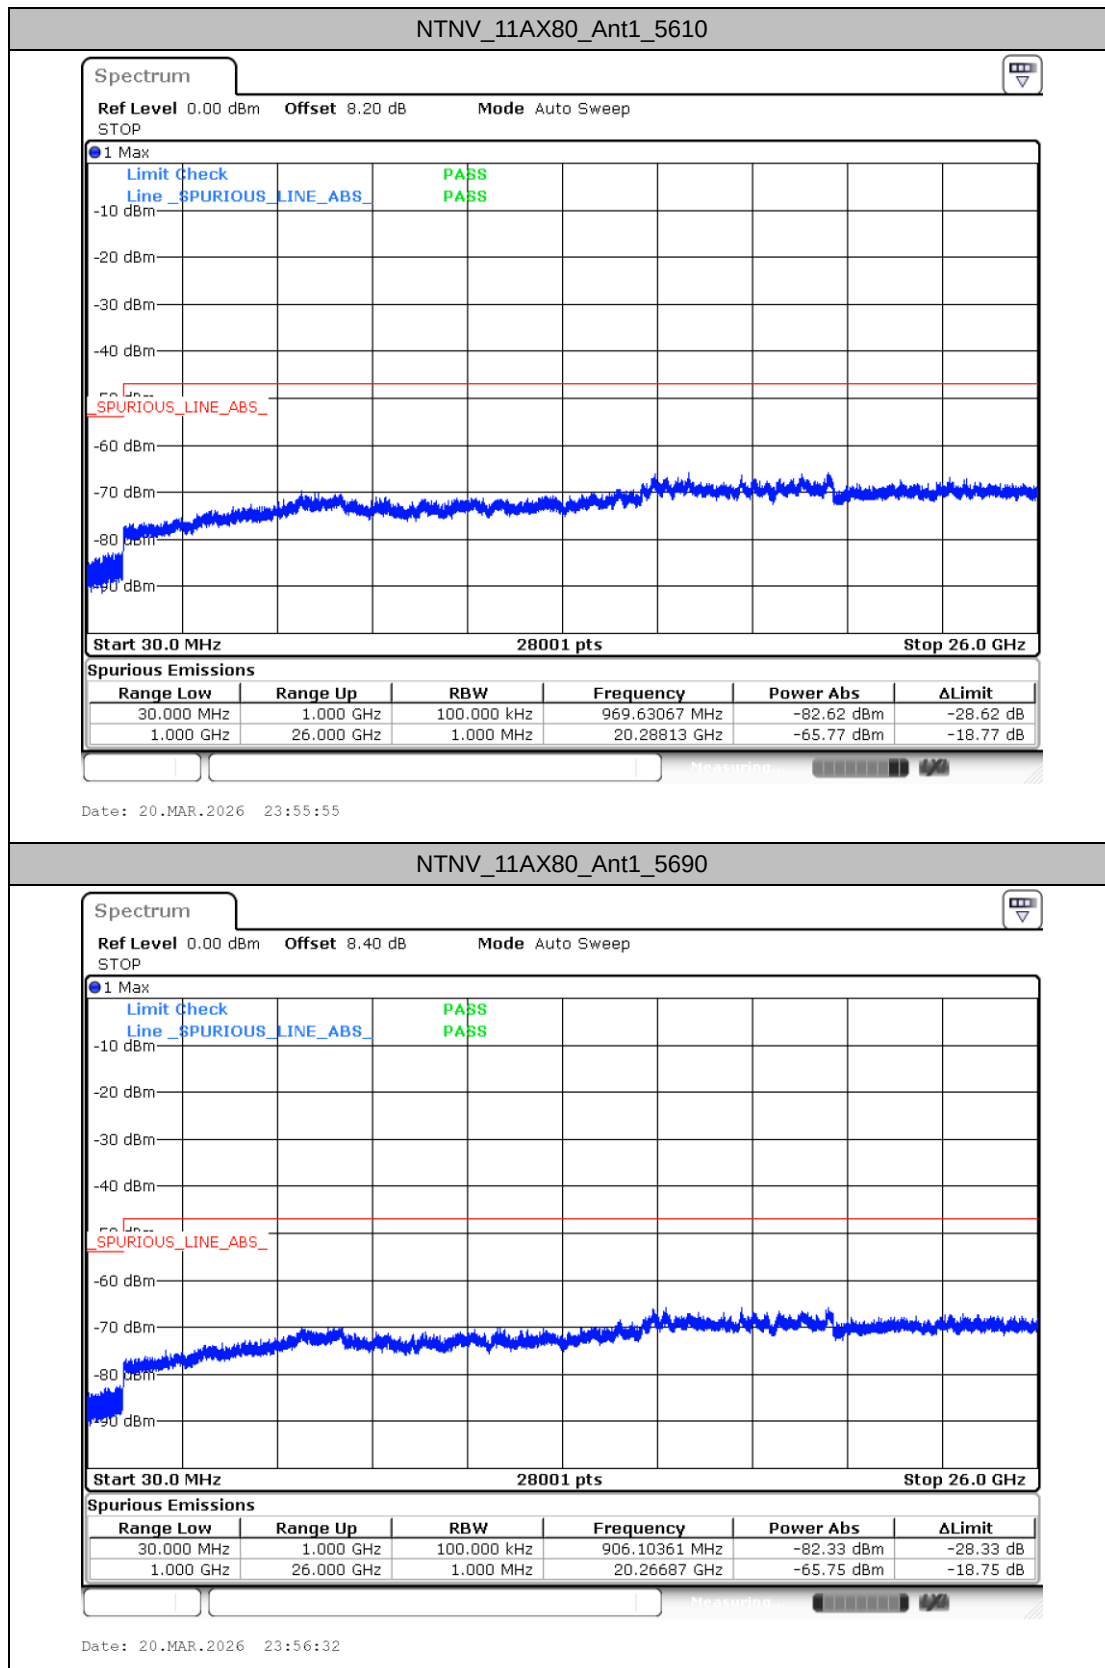

Adjacent Channel Leakage Power

Test Result

TestCondition	TestMode	Antenna	Freq(MHz)	Offset [MHz]	Result [dBc]	Limit [dBc]	Verdict
NTNV	11A	Ant1	5180	-40	-48.16	≤-40	PASS
				-20	-31.59	≤-25	PASS
				+20	-34.20	≤-25	PASS
				+40	-49.03	≤-40	PASS
			5200	-40	-47.99	≤-40	PASS
				-20	-31.19	≤-25	PASS
				+20	-33.72	≤-25	PASS
				+40	-48.47	≤-40	PASS
			5220	-40	-48.06	≤-40	PASS
				-20	-32.22	≤-25	PASS
				+20	-32.07	≤-25	PASS
				+40	-47.59	≤-40	PASS
			5240	-40	-46.97	≤-40	PASS
				-20	-30.75	≤-25	PASS
				+20	-31.29	≤-25	PASS
				+40	-45.73	≤-40	PASS
			5260	-40	-46.23	≤-40	PASS
				-20	-29.74	≤-25	PASS
				+20	-30.21	≤-25	PASS
				+40	-45.49	≤-40	PASS
			5280	-40	-46.87	≤-40	PASS
				-20	-30.32	≤-25	PASS
				+20	-30.14	≤-25	PASS
				+40	-45.26	≤-40	PASS
			5300	-40	-46.79	≤-40	PASS
				-20	-30.62	≤-25	PASS
				+20	-31.10	≤-25	PASS
				+40	-45.88	≤-40	PASS
			5320	-40	-46.90	≤-40	PASS
				-20	-30.79	≤-25	PASS
				+20	-31.18	≤-25	PASS
				+40	-46.33	≤-40	PASS
			5500	-40	-47.51	≤-40	PASS
				-20	-32.50	≤-25	PASS
				+20	-30.88	≤-25	PASS
				+40	-46.77	≤-40	PASS
			5600	-40	-47.67	≤-40	PASS

				-20	-29.24	≤-25	PASS
				+20	-30.15	≤-25	PASS
				+40	-45.42	≤-40	PASS
			5700	-40	-46.41	≤-40	PASS
				-20	-27.95	≤-25	PASS
				+20	-30.60	≤-25	PASS
				+40	-46.75	≤-40	PASS
			5720	-40	-45.84	≤-40	PASS
				-20	-28.36	≤-25	PASS
				+20	-30.46	≤-25	PASS
				+40	-46.21	≤-40	PASS
	11AC20	Ant1	5180	-40	-48.24	≤-40	PASS
				-20	-33.06	≤-25	PASS
				+20	-32.02	≤-25	PASS
				+40	-47.97	≤-40	PASS
			5200	-40	-47.75	≤-40	PASS
				-20	-32.38	≤-25	PASS
				+20	-32.09	≤-25	PASS
				+40	-47.71	≤-40	PASS
			5220	-40	-47.90	≤-40	PASS
				-20	-32.28	≤-25	PASS
				+20	-31.94	≤-25	PASS
				+40	-47.29	≤-40	PASS
			5240	-40	-46.87	≤-40	PASS
				-20	-30.79	≤-25	PASS
				+20	-30.78	≤-25	PASS
				+40	-45.86	≤-40	PASS
			5260	-40	-45.56	≤-40	PASS
				-20	-29.60	≤-25	PASS
				+20	-29.34	≤-25	PASS
				+40	-44.38	≤-40	PASS
			5280	-40	-46.46	≤-40	PASS
				-20	-30.27	≤-25	PASS
				+20	-30.16	≤-25	PASS
				+40	-44.54	≤-40	PASS
			5300	-40	-46.71	≤-40	PASS
				-20	-30.77	≤-25	PASS
				+20	-30.36	≤-25	PASS
				+40	-45.02	≤-40	PASS
			5320	-40	-47.13	≤-40	PASS
				-20	-30.83	≤-25	PASS
				+20	-30.71	≤-25	PASS
				+40	-45.82	≤-40	PASS

			5500	-40	-47.44	≤-40	PASS
				-20	-31.03	≤-25	PASS
				+20	-30.34	≤-25	PASS
				+40	-46.69	≤-40	PASS
			5600	-40	-47.70	≤-40	PASS
				-20	-29.56	≤-25	PASS
				+20	-29.61	≤-25	PASS
				+40	-46.94	≤-40	PASS
			5700	-40	-46.35	≤-40	PASS
				-20	-28.54	≤-25	PASS
				+20	-29.39	≤-25	PASS
				+40	-45.95	≤-40	PASS
			5720	-40	-46.46	≤-40	PASS
				-20	-28.62	≤-25	PASS
				+20	-29.42	≤-25	PASS
				+40	-45.21	≤-40	PASS
	11AC40	Ant1	5190	-80	-45.46	≤-40	PASS
				-40	-34.78	≤-25	PASS
				+40	-34.24	≤-25	PASS
				+80	-44.31	≤-40	PASS
			5230	-80	-44.45	≤-40	PASS
				-40	-31.66	≤-25	PASS
				+40	-31.59	≤-25	PASS
				+80	-41.92	≤-40	PASS
			5270	-80	-43.58	≤-40	PASS
				-40	-30.94	≤-25	PASS
				+40	-30.63	≤-25	PASS
				+80	-40.48	≤-40	PASS
			5310	-80	-43.80	≤-40	PASS
				-40	-30.81	≤-25	PASS
				+40	-32.24	≤-25	PASS
				+80	-40.72	≤-40	PASS
			5510	-80	-44.86	≤-40	PASS
				-40	-34.82	≤-25	PASS
				+40	-36.11	≤-25	PASS
				+80	-44.57	≤-40	PASS
			5590	-80	-45.85	≤-40	PASS
				-40	-34.81	≤-25	PASS
				+40	-33.95	≤-25	PASS
				+80	-44.72	≤-40	PASS
			5670	-80	-44.88	≤-40	PASS
				-40	-37.19	≤-25	PASS
				+40	-35.99	≤-25	PASS

			5710	+80	-44.70	≤-40	PASS
				-80	-44.64	≤-40	PASS
				-40	-31.70	≤-25	PASS
				+40	-35.41	≤-25	PASS
				+80	-43.70	≤-40	PASS
	11AC80	Ant1	5210	-80	-30.41	≤-25	PASS
				+80	-26.42	≤-25	PASS
			5290	-80	-28.76	≤-25	PASS
				+80	-25.38	≤-25	PASS
			5530	-80	-30.38	≤-25	PASS
				+80	-32.52	≤-25	PASS
			5610	-80	-33.91	≤-25	PASS
				+80	-33.49	≤-25	PASS
			5690	-80	-26.01	≤-25	PASS
				+80	-25.14	≤-25	PASS
	11AX20	Ant1	5180	-40	-48.39	≤-40	PASS
				-20	-29.76	≤-25	PASS
				+20	-31.83	≤-25	PASS
				+40	-50.04	≤-40	PASS
			5200	-40	-48.27	≤-40	PASS
				-20	-28.91	≤-25	PASS
				+20	-31.12	≤-25	PASS
				+40	-49.13	≤-40	PASS
			5220	-40	-48.82	≤-40	PASS
				-20	-31.35	≤-25	PASS
				+20	-30.02	≤-25	PASS
				+40	-47.75	≤-40	PASS
			5240	-40	-47.33	≤-40	PASS
				-20	-30.11	≤-25	PASS
				+20	-29.29	≤-25	PASS
				+40	-46.16	≤-40	PASS
			5260	-40	-48.01	≤-40	PASS
				-20	-29.23	≤-25	PASS
				+20	-28.06	≤-25	PASS
				+40	-46.94	≤-40	PASS
			5280	-40	-47.41	≤-40	PASS
				-20	-30.44	≤-25	PASS
				+20	-30.28	≤-25	PASS
				+40	-44.46	≤-40	PASS
			5300	-40	-47.55	≤-40	PASS
				-20	-29.83	≤-25	PASS
				+20	-29.93	≤-25	PASS
				+40	-46.06	≤-40	PASS

			5320	-40	-48.02	≤-40	PASS
				-20	-31.03	≤-25	PASS
				+20	-29.92	≤-25	PASS
				+40	-46.83	≤-40	PASS
			5500	-40	-48.66	≤-40	PASS
				-20	-29.39	≤-25	PASS
				+20	-27.59	≤-25	PASS
				+40	-48.09	≤-40	PASS
			5600	-40	-49.21	≤-40	PASS
				-20	-28.90	≤-25	PASS
				+20	-27.50	≤-25	PASS
				+40	-48.31	≤-40	PASS
			5700	-40	-47.86	≤-40	PASS
				-20	-28.30	≤-25	PASS
				+20	-28.32	≤-25	PASS
				+40	-47.02	≤-40	PASS
			5720	-40	-47.62	≤-40	PASS
				-20	-28.29	≤-25	PASS
				+20	-28.57	≤-25	PASS
				+40	-46.17	≤-40	PASS
	11AX40	Ant1	5190	-80	-46.85	≤-40	PASS
				-40	-36.43	≤-25	PASS
				+40	-34.81	≤-25	PASS
				+80	-46.18	≤-40	PASS
			5230	-80	-45.84	≤-40	PASS
				-40	-33.83	≤-25	PASS
				+40	-33.74	≤-25	PASS
				+80	-43.47	≤-40	PASS
			5270	-80	-45.04	≤-40	PASS
				-40	-33.18	≤-25	PASS
				+40	-32.28	≤-25	PASS
				+80	-42.91	≤-40	PASS
			5310	-80	-45.27	≤-40	PASS
				-40	-32.71	≤-25	PASS
				+40	-33.58	≤-25	PASS
				+80	-43.31	≤-40	PASS
			5510	-80	-46.44	≤-40	PASS
				-40	-36.85	≤-25	PASS
				+40	-36.45	≤-25	PASS
				+80	-46.07	≤-40	PASS
			5590	-80	-47.54	≤-40	PASS
				-40	-36.00	≤-25	PASS
				+40	-33.21	≤-25	PASS

				+80	-46.24	≤-40	PASS
			5670	-80	-46.41	≤-40	PASS
				-40	-36.77	≤-25	PASS
				+40	-35.10	≤-25	PASS
				+80	-46.25	≤-40	PASS
				-80	-46.32	≤-40	PASS
			5710	-40	-33.06	≤-25	PASS
				+40	-35.77	≤-25	PASS
				+80	-44.98	≤-40	PASS
				-80	-32.11	≤-25	PASS
	11AX80	Ant1	5210	+80	-28.13	≤-25	PASS
				-80	-30.21	≤-25	PASS
			5290	+80	-26.54	≤-25	PASS
				-80	-31.97	≤-25	PASS
			5530	+80	-33.51	≤-25	PASS
				-80	-34.97	≤-25	PASS
			5610	+80	-33.26	≤-25	PASS
				-80	-27.35	≤-25	PASS
			5690	+80	-26.72	≤-25	PASS
				-80	-26.72	≤-25	PASS

Test Graphs

