




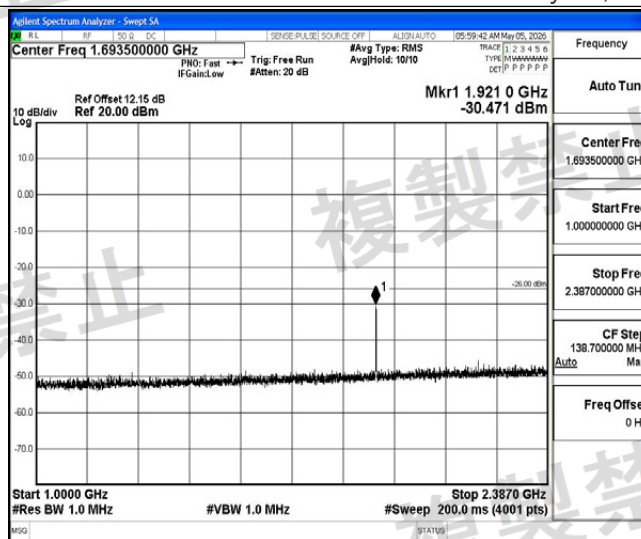


NTVN-3DH5-Ant1-2441-1000~2387-PASS

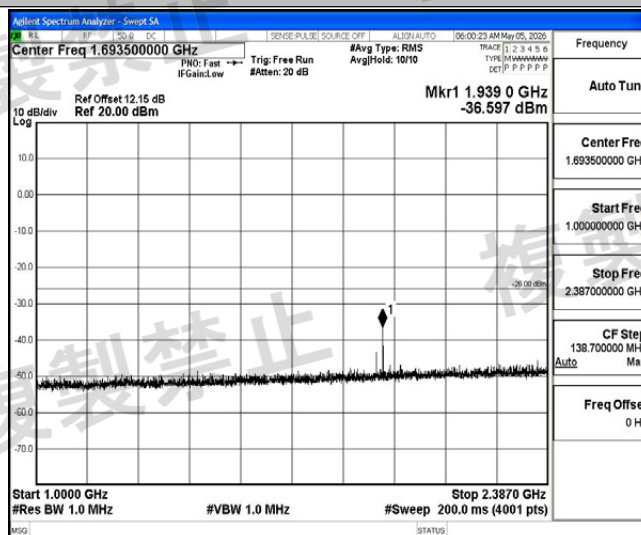


NTHV-3DH5-Ant1-2441-1000~2387-PASS

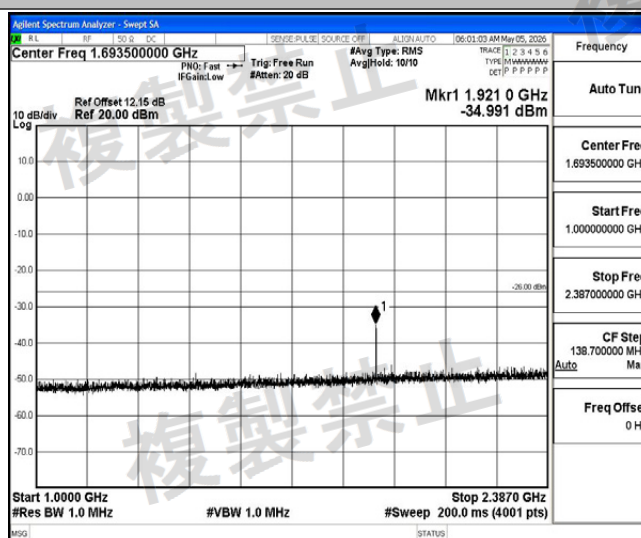


NTLV-3DH5-Ant1-2441-2387~2400-PASS

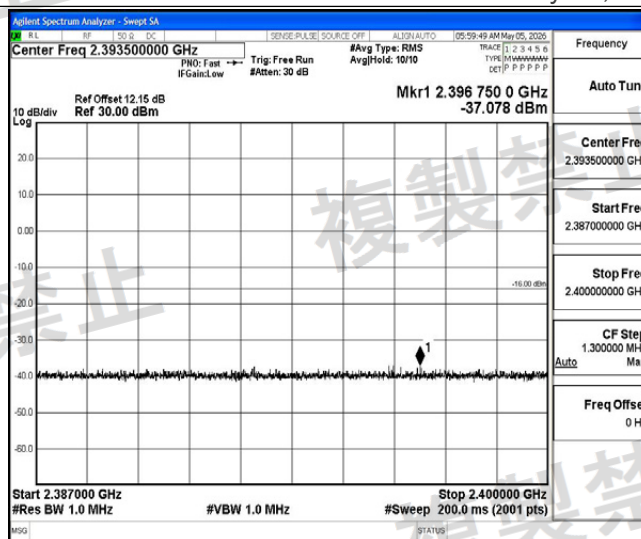


NTNV-3DH5-Ant1-2441-2387~2400-PASS

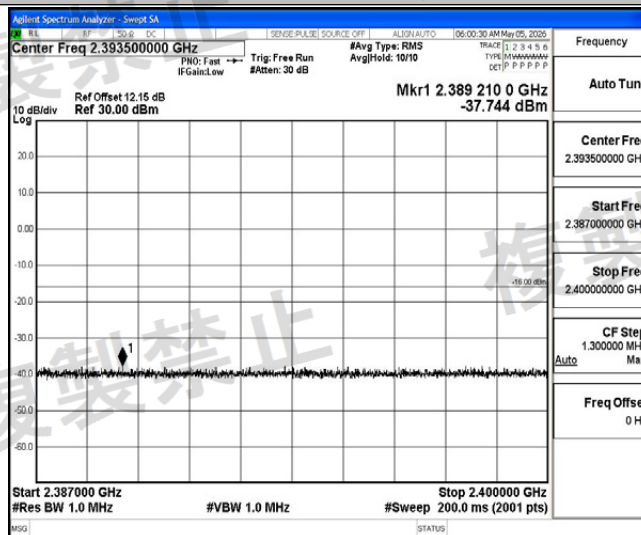


NTHV-3DH5-Ant1-2441-2387~2400-PASS

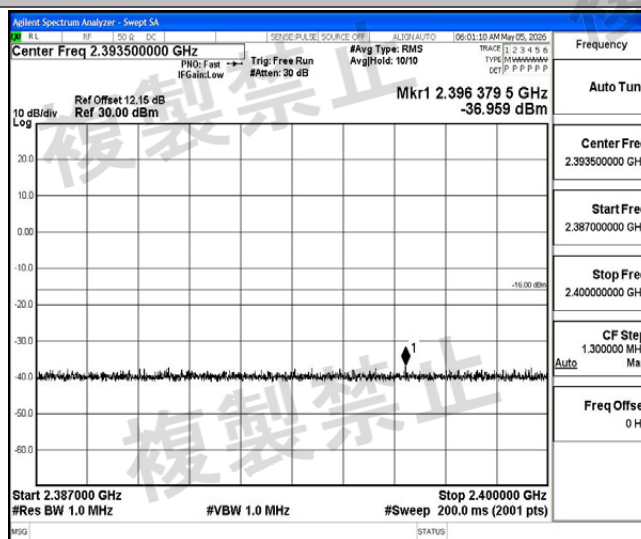


NTLV-3DH5-Ant1-2441-2483.5~2496.5-PASS

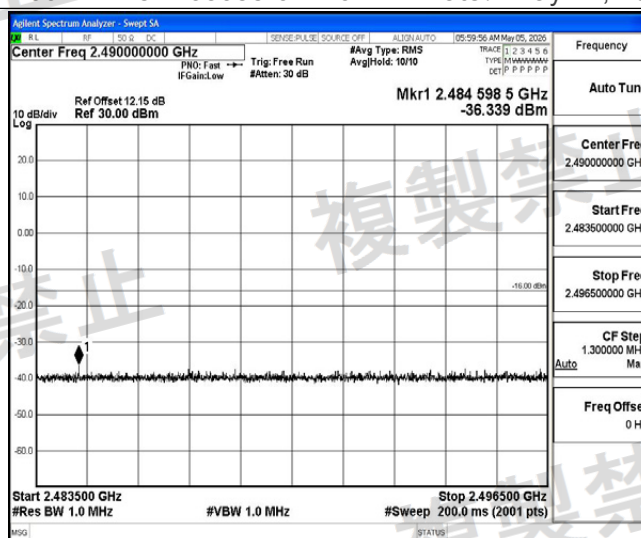

NTNV-3DH5-Ant1-2441-2483.5~2496.5-PASS

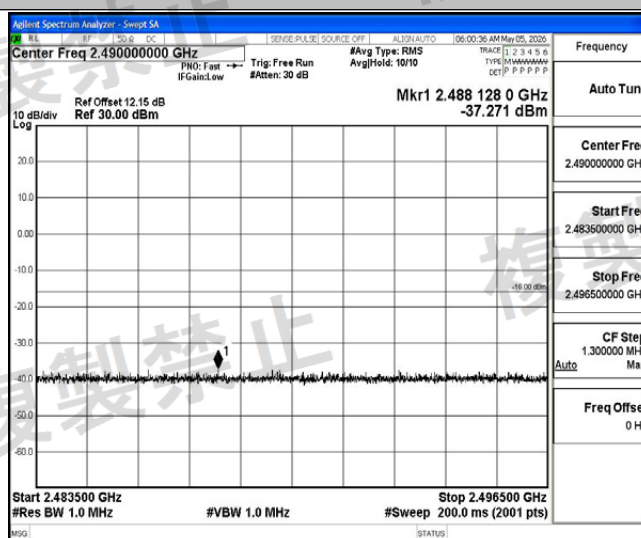


NTHV-3DH5-Ant1-2441-2483.5~2496.5-PASS

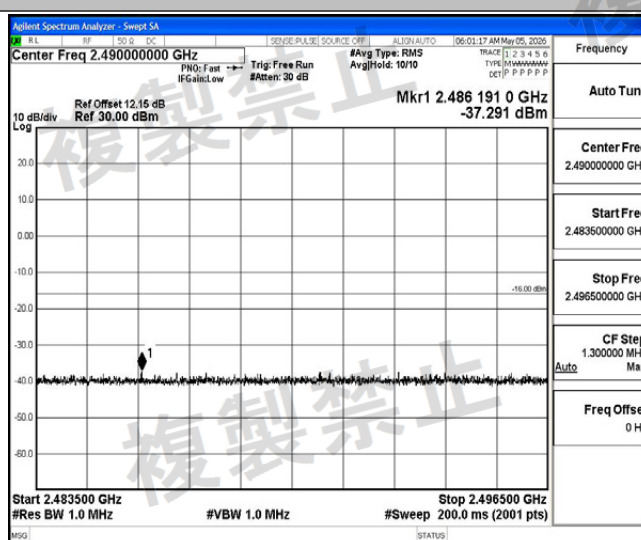


NTLV-3DH5-Ant1-2441-2496.5~13000-PASS


Dongguan DN Testing Co., Ltd.

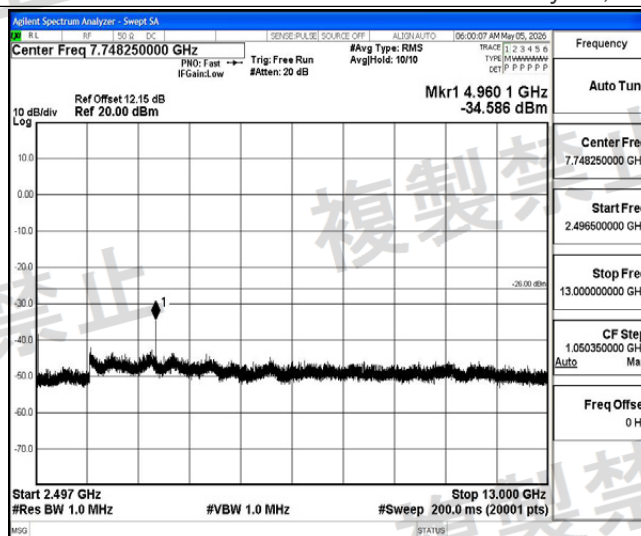


NTNV-3DH5-Ant1-2441-2496.5~13000-PASS

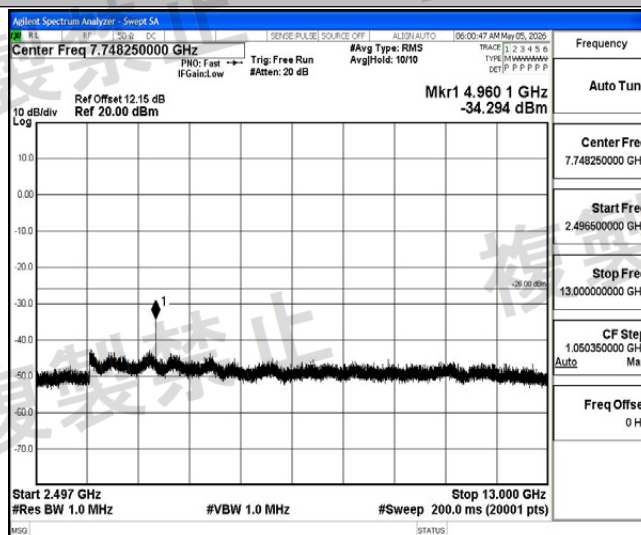


NTHV-3DH5-Ant1-2441-2496.5~13000-PASS

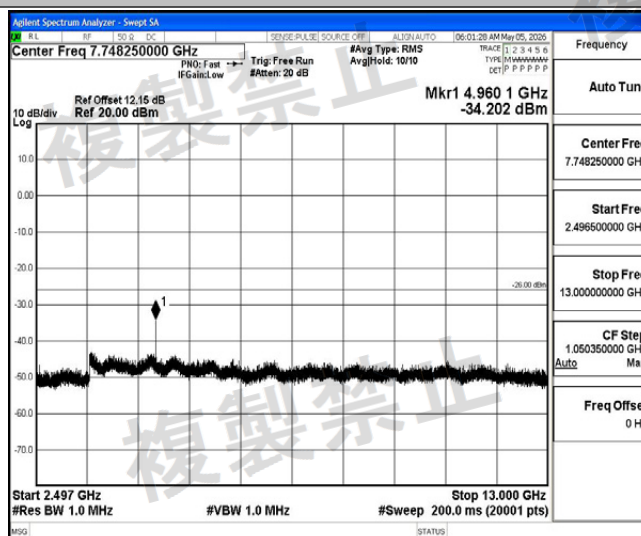


NTLV-3DH5-Ant1-2480-30~1000-PASS

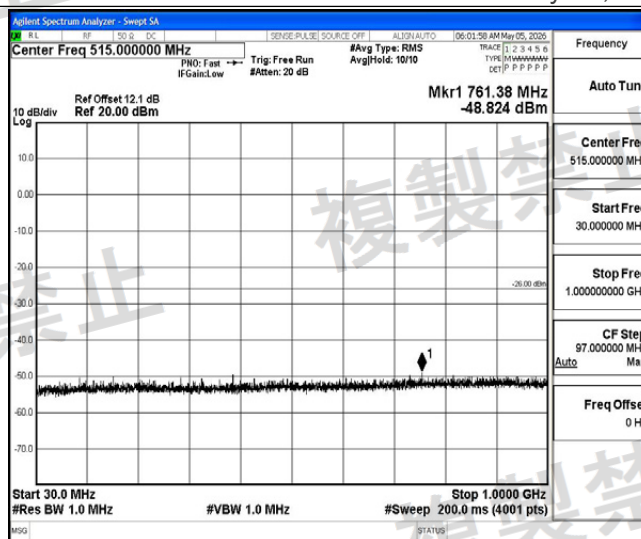


NTNV-3DH5-Ant1-2480-30~1000-PASS

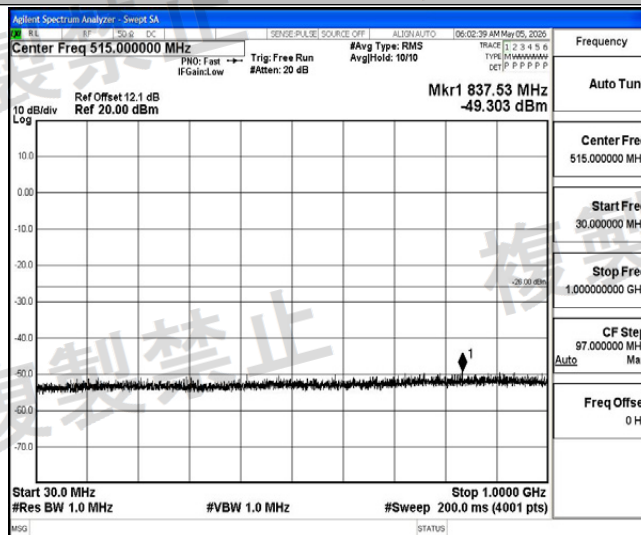


NTHV-3DH5-Ant1-2480-30~1000-PASS

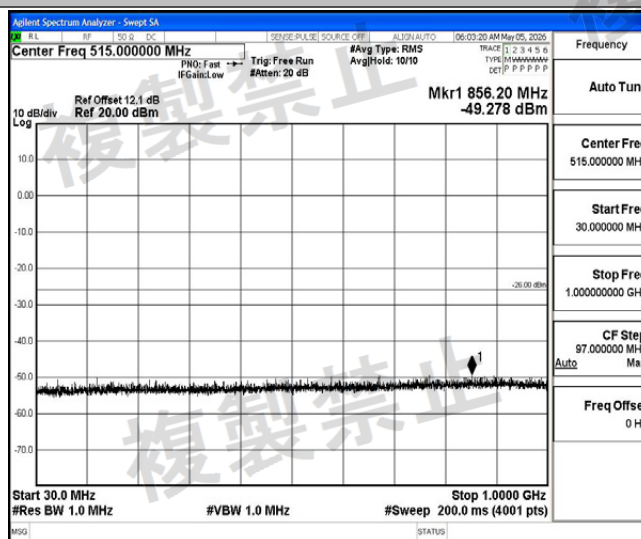


NTLV-3DH5-Ant1-2480-1000~2387-PASS

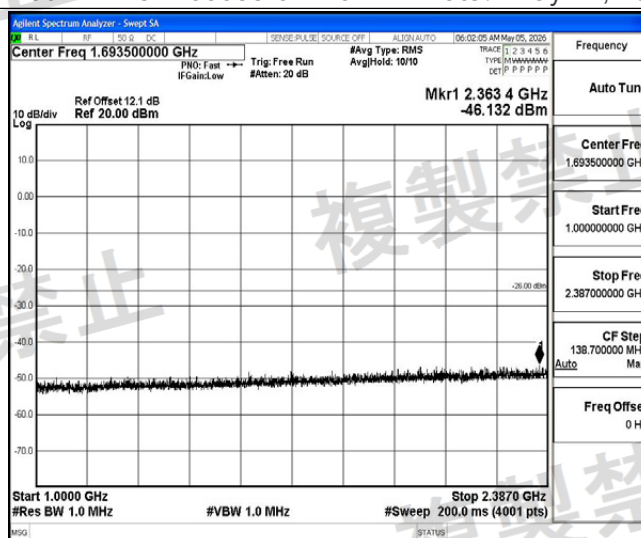


NTNV-3DH5-Ant1-2480-1000~2387-PASS

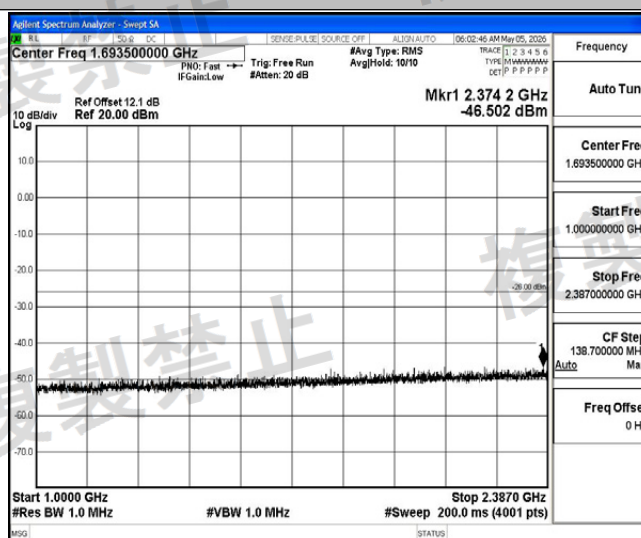


NTHV-3DH5-Ant1-2480-1000~2387-PASS

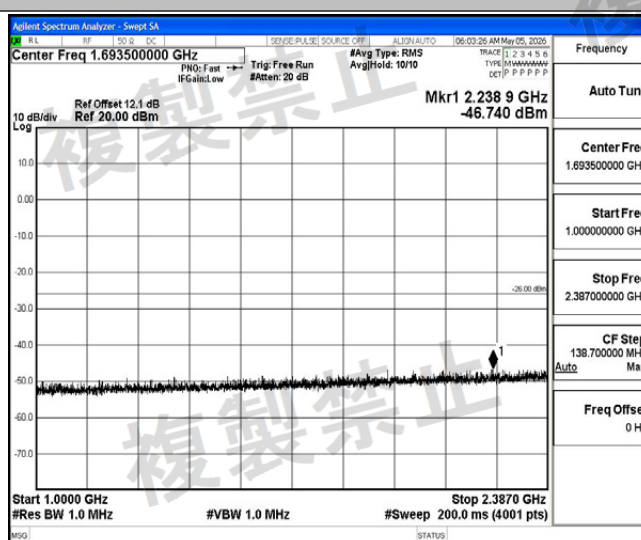


NTLV-3DH5-Ant1-2480-2387~2400-PASS

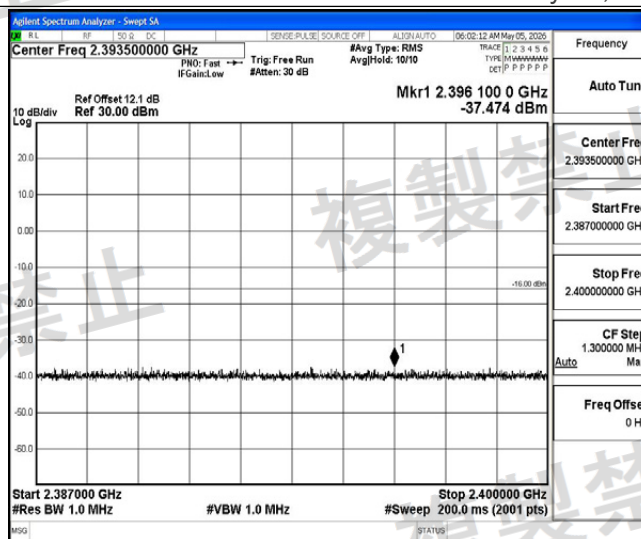


NTNV-3DH5-Ant1-2480-2387~2400-PASS

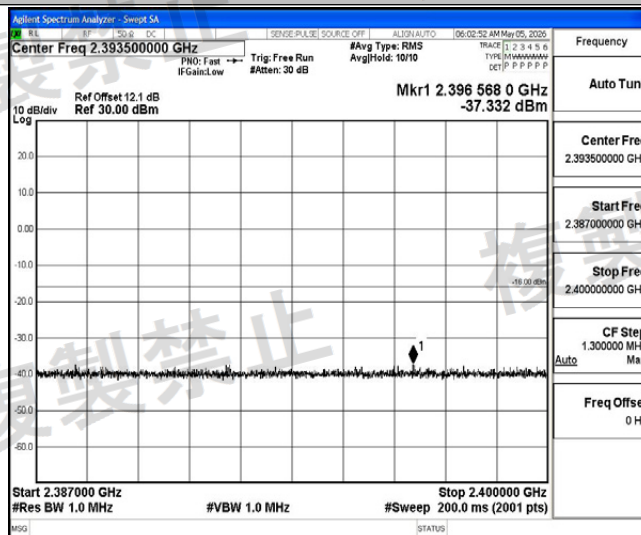


NTHV-3DH5-Ant1-2480-2387~2400-PASS

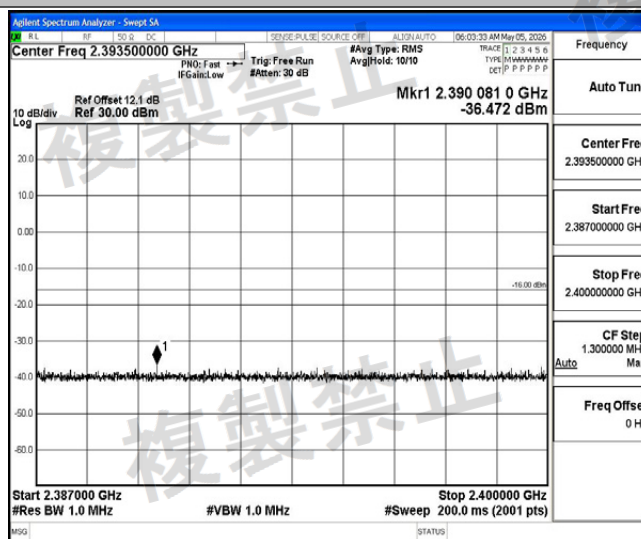


NTLV-3DH5-Ant1-2480-2483.5~2496.5-PASS

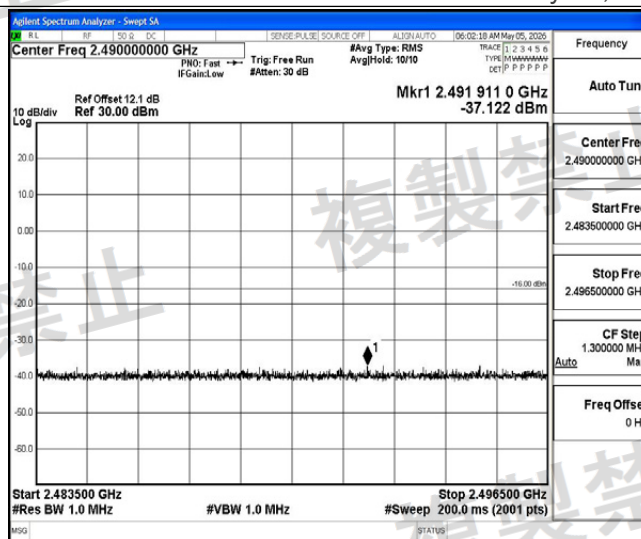


NTNV-3DH5-Ant1-2480-2483.5~2496.5-PASS

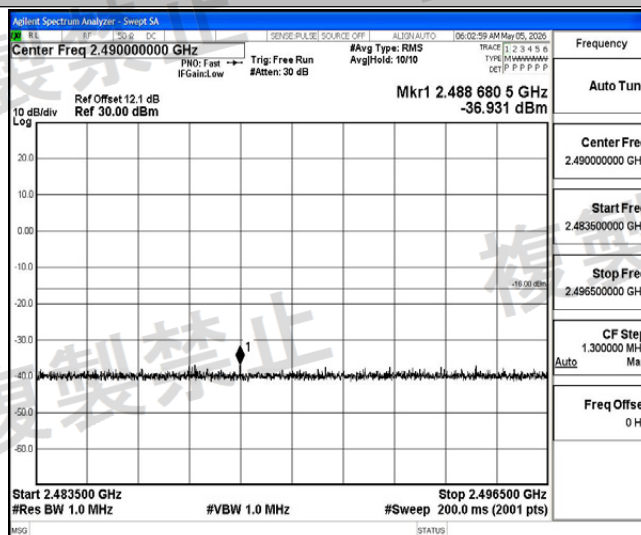


NTHV-3DH5-Ant1-2480-2483.5~2496.5-PASS

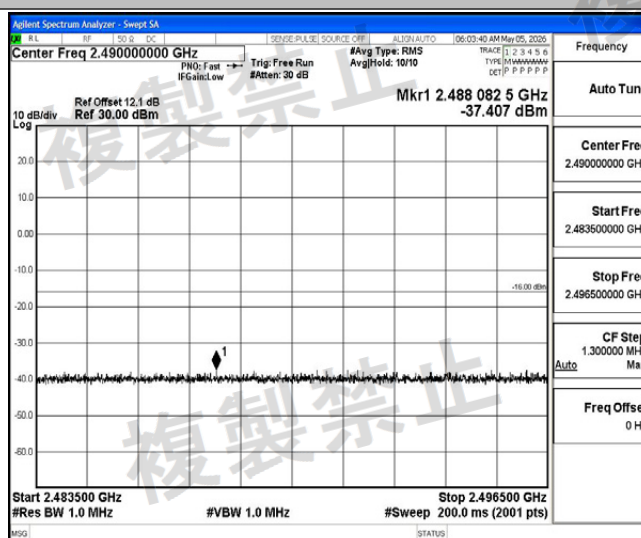


NTLV-3DH5-Ant1-2480-2496.5~13000-PASS

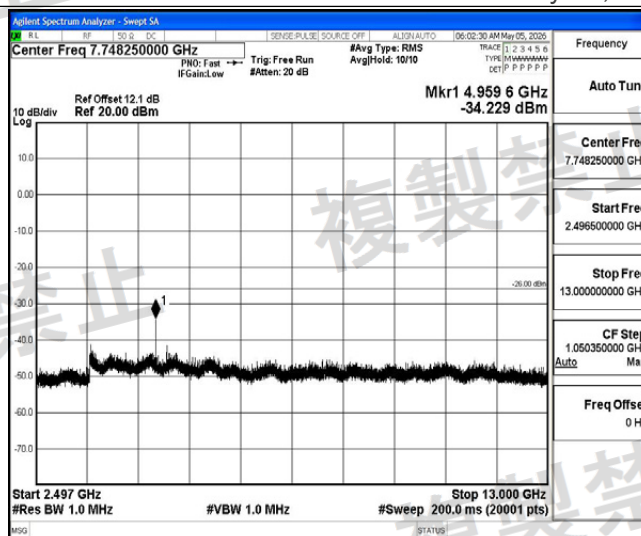

NTNV-3DH5-Ant1-2480-2496.5~13000-PASS

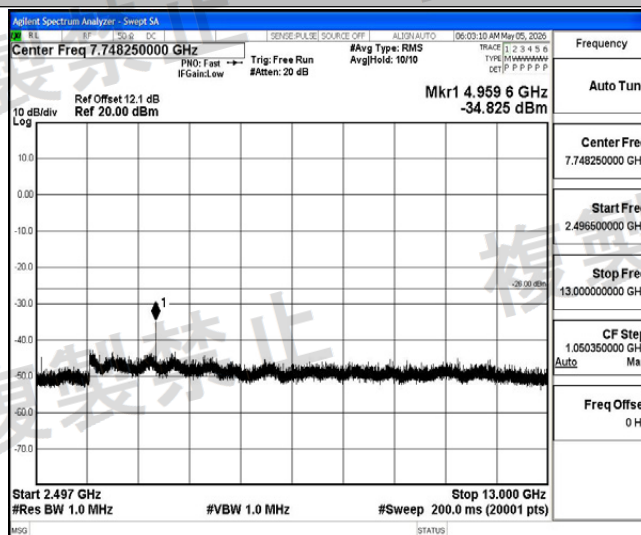



NTHV-3DH5-Ant1-2480-2496.5~13000-PASS

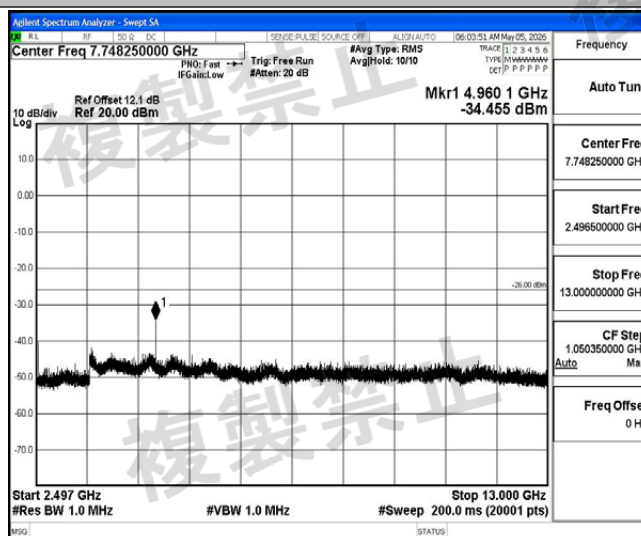





Test Graphs_Step2

NTLV-DH5-Ant1-2402-2496.5~13000-PASS

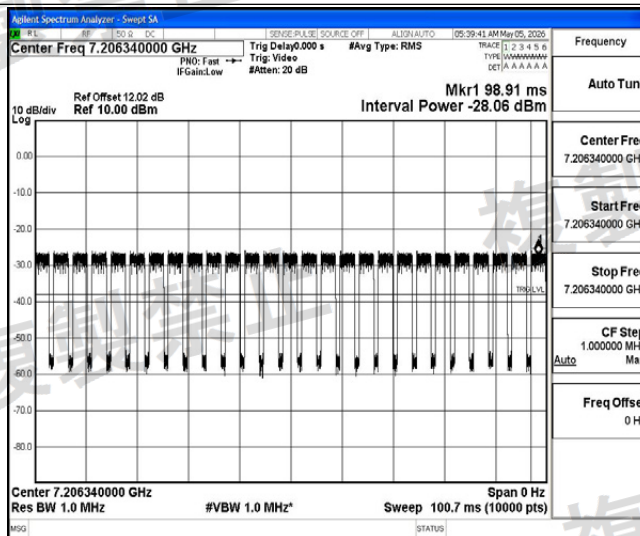
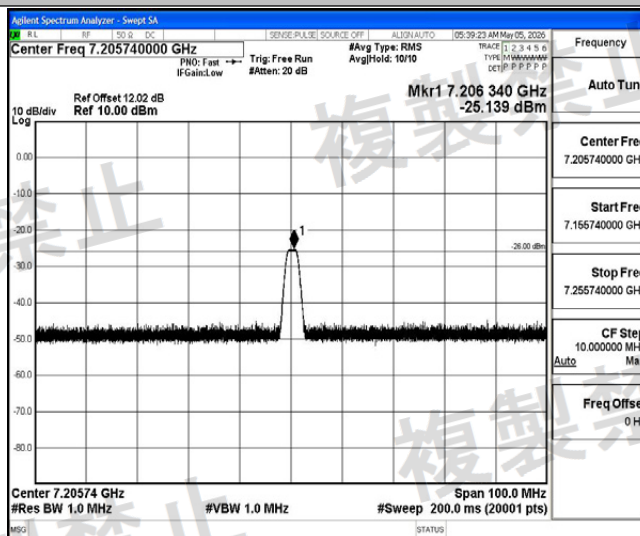


NTNV-DH5-Ant1-2402-2496.5~13000-PASS


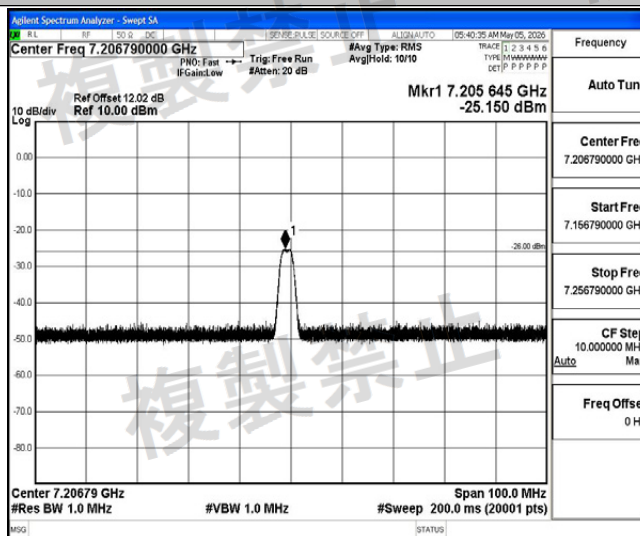


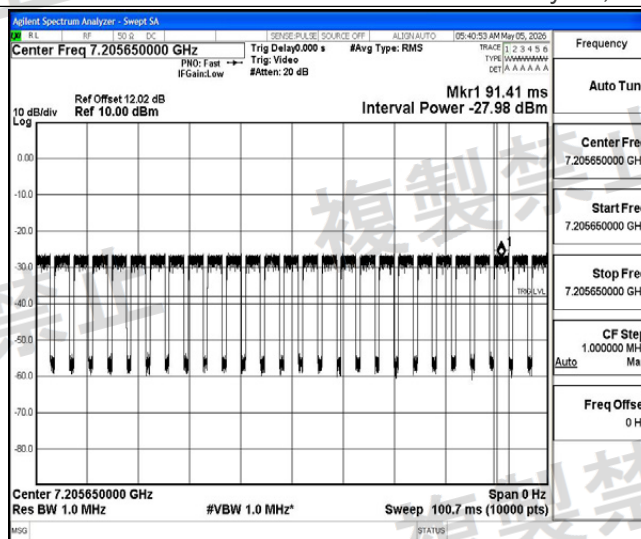


NTHV-DH5-Ant1-2402-2496.5~13000-PASS

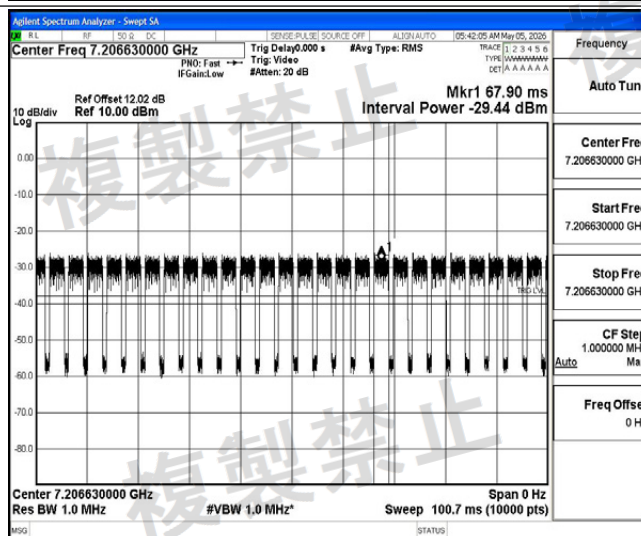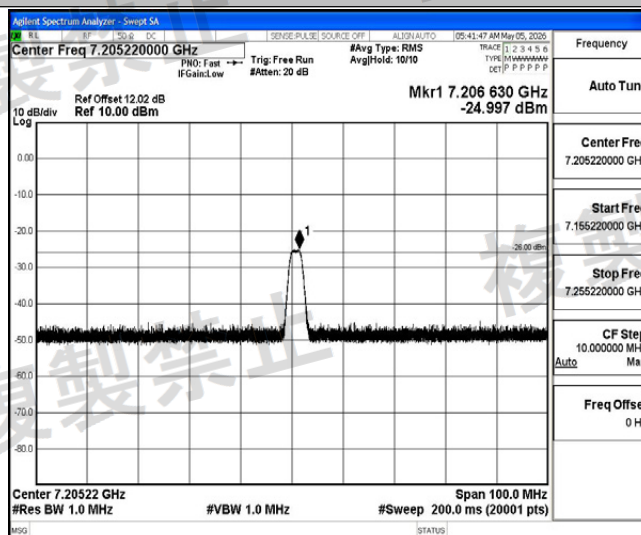


NTLV-DH5-Ant1-2441-2496.5~13000-PASS

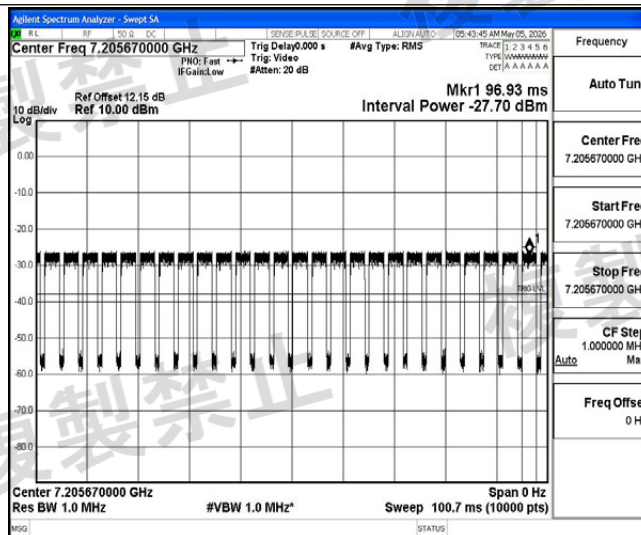
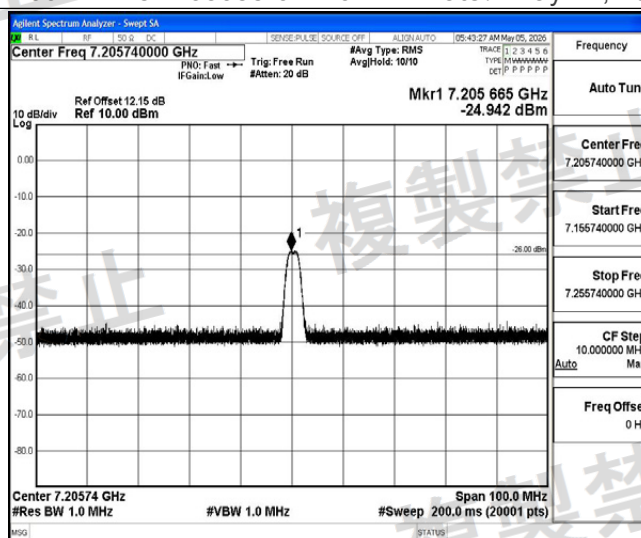


NTNV-DH5-Ant1-2441-2496.5~13000-PASS

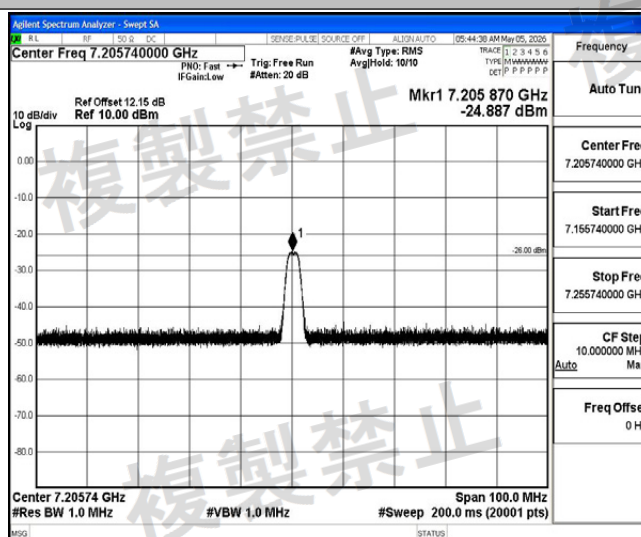


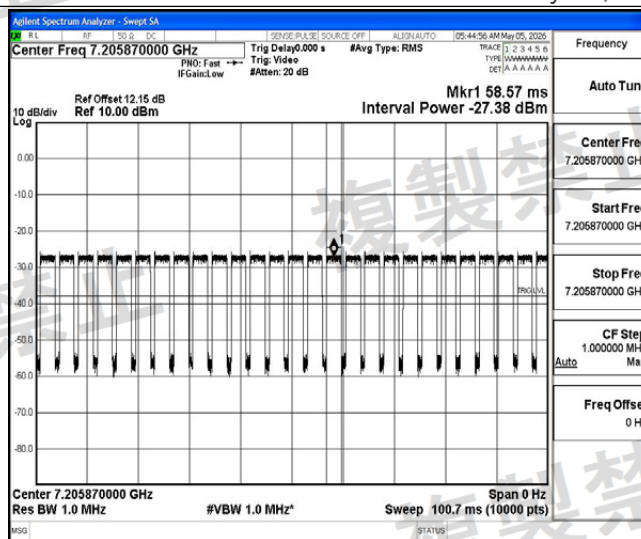


NTHV-DH5-Ant1-2441-2496.5~13000-PASS

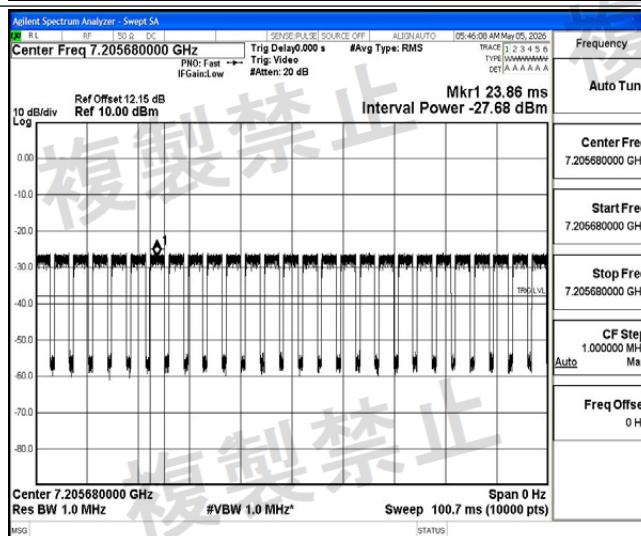
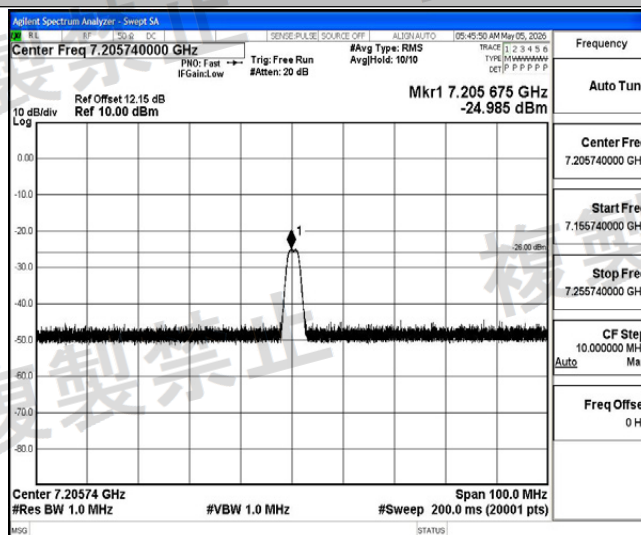


NTLV-DH5-Ant1-2480-2496.5~13000-PASS

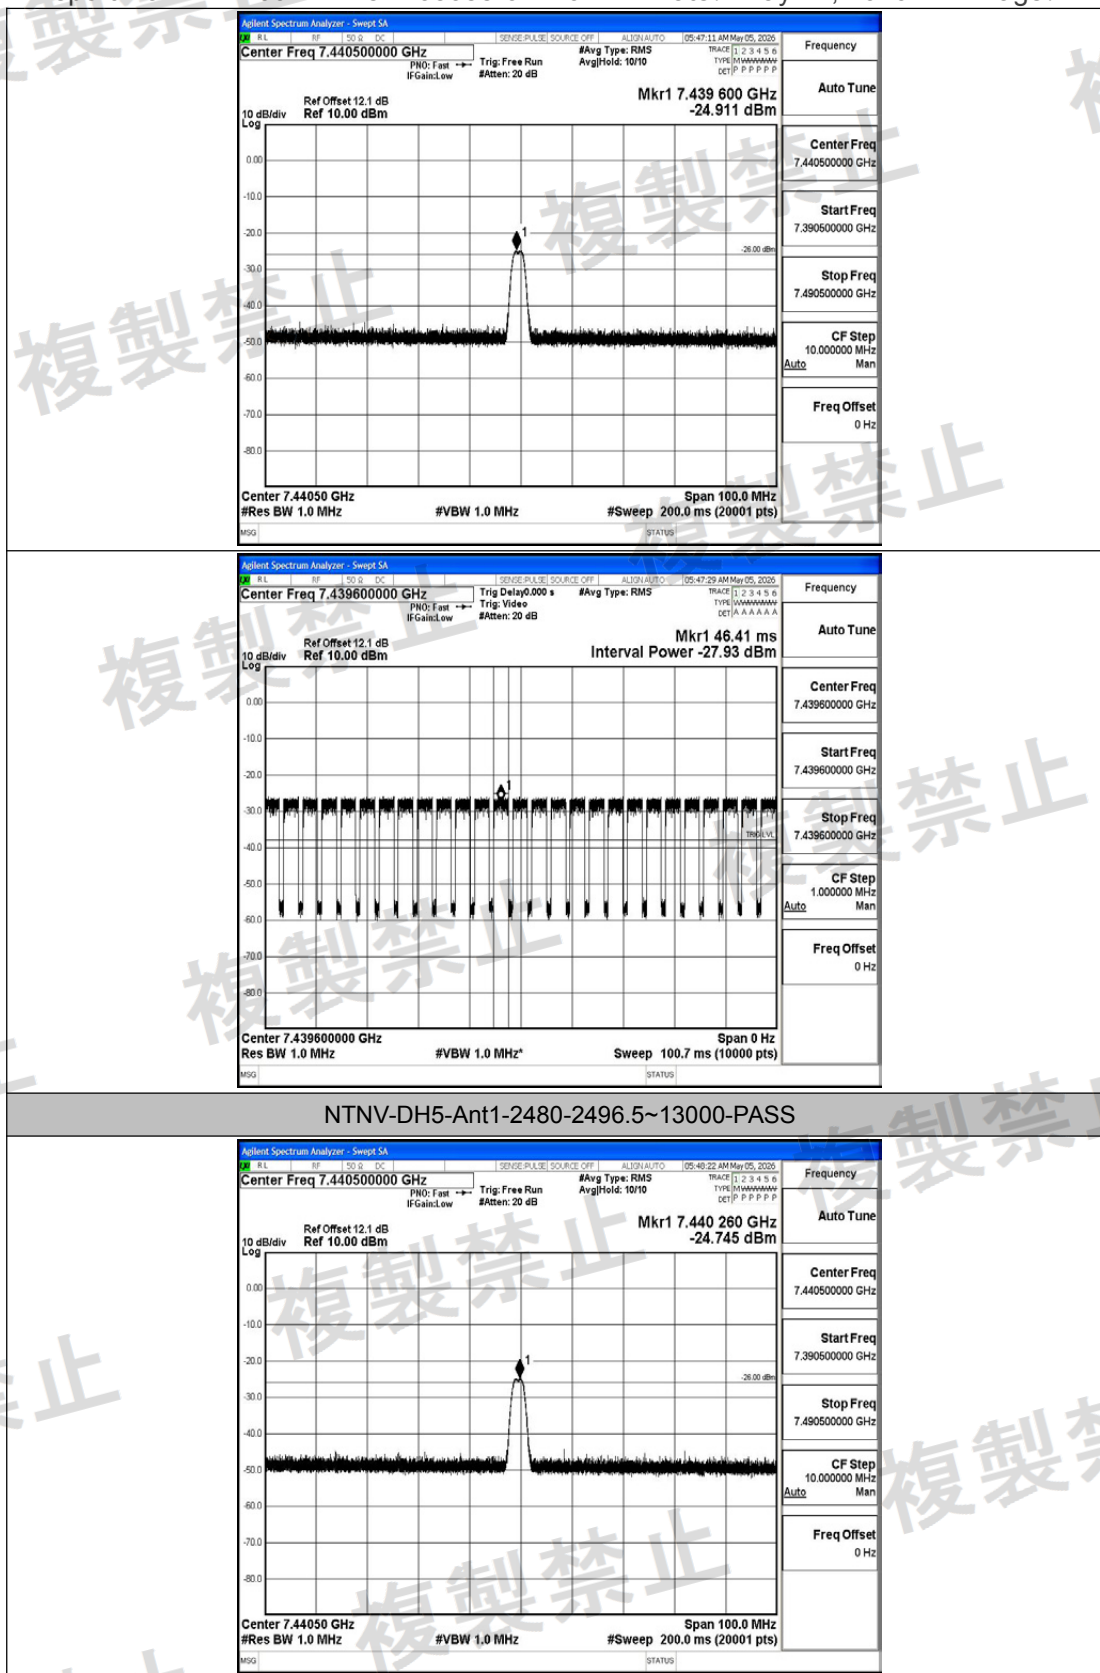


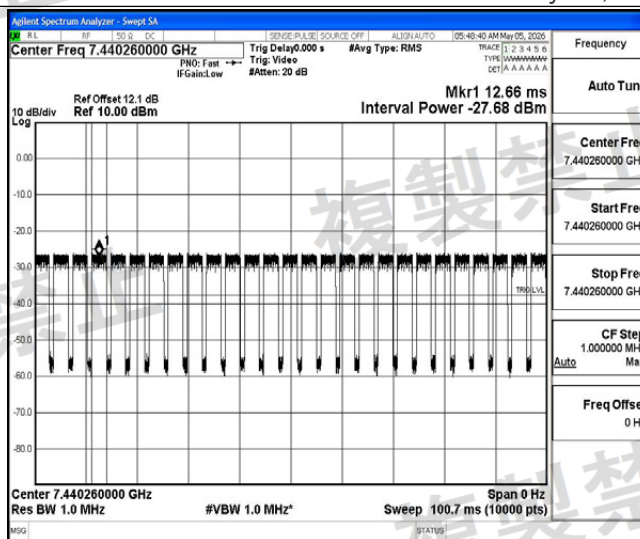

NTNV-2DH5-Ant1-2441-1000~2387-PASS

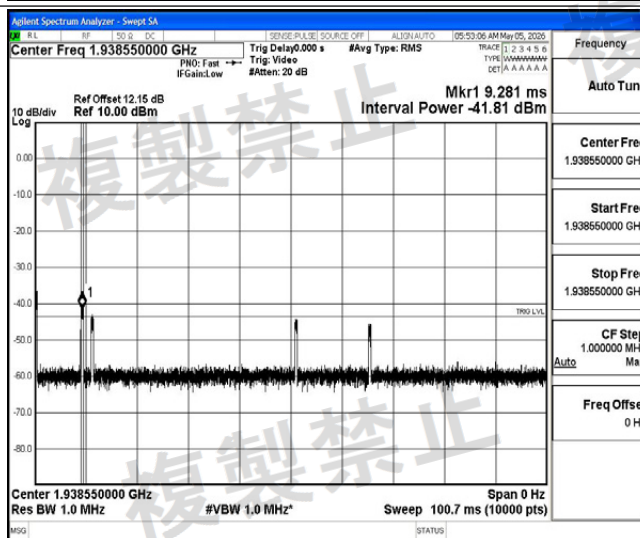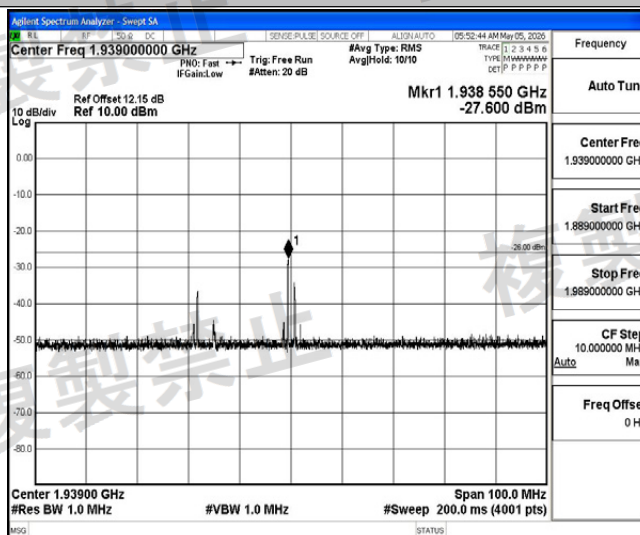

NTNV-3DH5-Ant1-2402-1000~2387-PASS

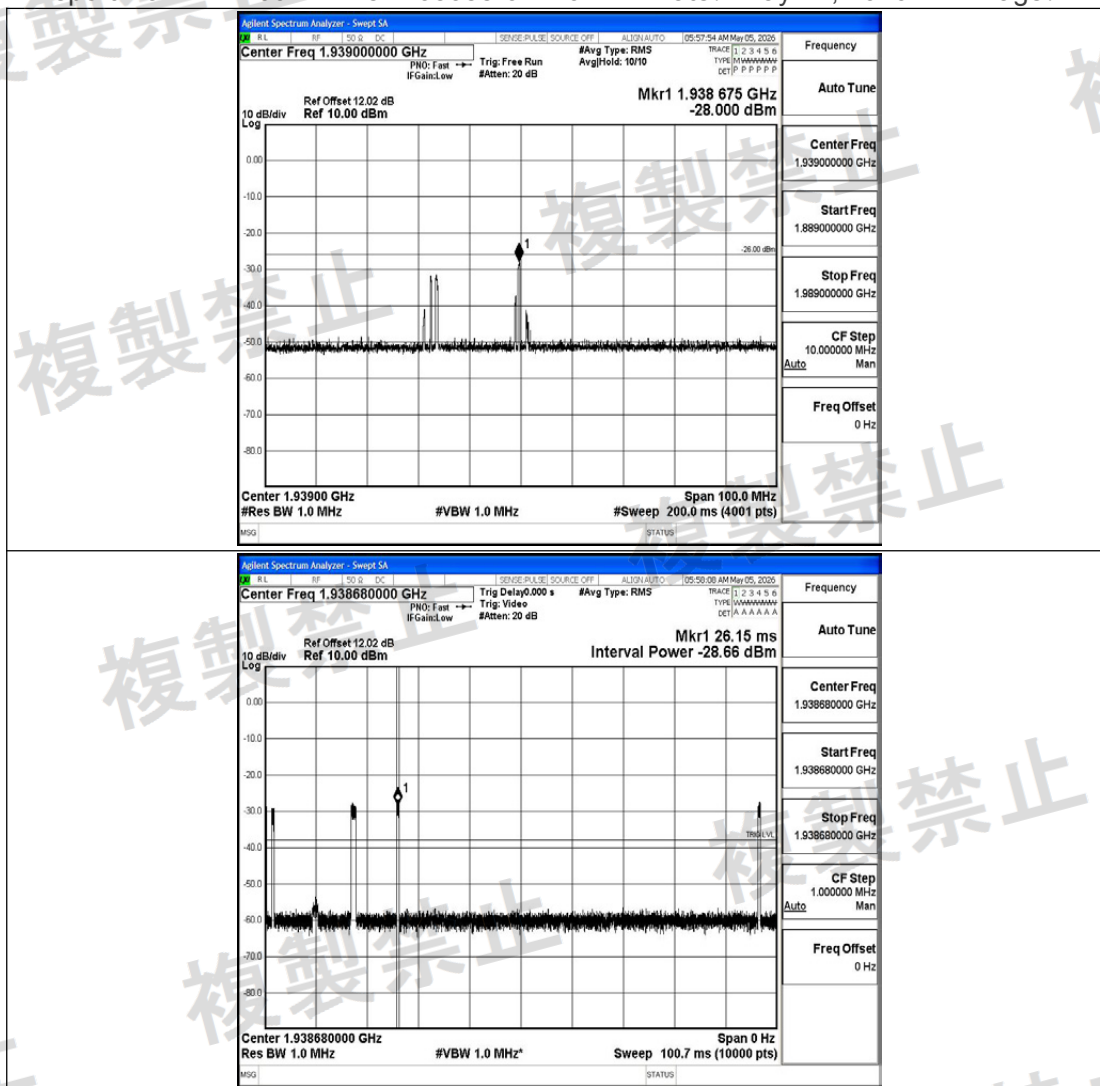

Note: SA set to from 2.4965GHz to 13GHz, plot shows from 2.497GHz to 13GHz as of SA's default format.

**Appendix G: Spurious Emission of RX****Test Result**

Test Condition	Test Mode	Antenna	Freq (MHz)	Freq.Range [MHz]	Freq. [MHz]	Result [dBm]	Limit [dBm]	Result [nW]	Limit [nW]	Verdict
NTLV	DH5	Ant1	2402	30~1000	74.62	-78.48	≤-54	0.01419	≤4	PASS
NTNV	DH5	Ant1	2402	30~1000	75.11	-78.67	≤-54	0.01358	≤4	PASS
NTHV	DH5	Ant1	2402	30~1000	75.11	-77.26	≤-54	0.01879	≤4	PASS
NTLV	DH5	Ant1	2402	1000~12500	4807.08	-62.52	≤-47	0.55976	≤20	PASS
NTNV	DH5	Ant1	2402	1000~12500	3604.18	-61.72	≤-47	0.67298	≤20	PASS
NTHV	DH5	Ant1	2402	1000~12500	5264.78	-62.91	≤-47	0.51168	≤20	PASS
NTLV	DH5	Ant1	2441	30~1000	74.62	-77.98	≤-54	0.01592	≤4	PASS
NTNV	DH5	Ant1	2441	30~1000	74.62	-76.63	≤-54	0.02173	≤4	PASS
NTHV	DH5	Ant1	2441	30~1000	74.62	-77.56	≤-54	0.01754	≤4	PASS
NTLV	DH5	Ant1	2441	1000~12500	3628.33	-63.08	≤-47	0.49204	≤20	PASS
NTNV	DH5	Ant1	2441	1000~12500	4842.15	-62.22	≤-47	0.59979	≤20	PASS
NTHV	DH5	Ant1	2441	1000~12500	3640.40	-61.97	≤-47	0.63533	≤20	PASS
NTLV	DH5	Ant1	2480	30~1000	74.62	-77.48	≤-54	0.01786	≤4	PASS
NTNV	DH5	Ant1	2480	30~1000	742.47	-78.48	≤-54	0.01419	≤4	PASS
NTHV	DH5	Ant1	2480	30~1000	74.62	-77.61	≤-54	0.01734	≤4	PASS
NTLV	DH5	Ant1	2480	1000~12500	4850.78	-61.66	≤-47	0.68234	≤20	PASS
NTNV	DH5	Ant1	2480	1000~12500	3600.15	-62.54	≤-47	0.55719	≤20	PASS
NTHV	DH5	Ant1	2480	1000~12500	3605.33	-62.77	≤-47	0.52845	≤20	PASS
NTLV	2DH5	Ant1	2402	30~1000	75.11	-78.53	≤-54	0.01403	≤4	PASS
NTNV	2DH5	Ant1	2402	30~1000	74.14	-78.21	≤-54	0.01510	≤4	PASS
NTHV	2DH5	Ant1	2402	30~1000	75.11	-77.52	≤-54	0.01770	≤4	PASS
NTLV	2DH5	Ant1	2402	1000~12500	4123.98	-62.82	≤-47	0.52240	≤20	PASS
NTNV	2DH5	Ant1	2402	1000~12500	3682.38	-62.26	≤-47	0.59429	≤20	PASS
NTHV	2DH5	Ant1	2402	1000~12500	5282.60	-62.88	≤-47	0.51523	≤20	PASS
NTLV	2DH5	Ant1	2441	30~1000	74.62	-79.08	≤-54	0.01236	≤4	PASS
NTNV	2DH5	Ant1	2441	30~1000	75.11	-78.36	≤-54	0.01459	≤4	PASS
NTHV	2DH5	Ant1	2441	30~1000	74.14	-78.81	≤-54	0.01315	≤4	PASS
NTLV	2DH5	Ant1	2441	1000~12500	2407.03	-61.59	≤-47	0.69343	≤20	PASS
NTNV	2DH5	Ant1	2441	1000~12500	4070.50	-63.25	≤-47	0.47315	≤20	PASS
NTHV	2DH5	Ant1	2441	1000~12500	3610.50	-62.40	≤-47	0.57544	≤20	PASS
NTLV	2DH5	Ant1	2480	30~1000	75.11	-78.09	≤-54	0.01552	≤4	PASS
NTNV	2DH5	Ant1	2480	30~1000	74.14	-79.69	≤-54	0.01074	≤4	PASS
NTHV	2DH5	Ant1	2480	30~1000	74.62	-78.93	≤-54	0.01279	≤4	PASS
NTLV	2DH5	Ant1	2480	1000~12500	3613.95	-62.44	≤-47	0.57016	≤20	PASS
NTNV	2DH5	Ant1	2480	1000~12500	3673.75	-62.77	≤-47	0.52845	≤20	PASS
NTHV	2DH5	Ant1	2480	1000~12500	3631.78	-62.57	≤-47	0.55335	≤20	PASS
NTLV	3DH5	Ant1	2402	30~1000	75.11	-78.27	≤-54	0.01489	≤4	PASS
NTNV	3DH5	Ant1	2402	30~1000	74.62	-78.95	≤-54	0.01274	≤4	PASS

Dongguan DN Testing Co., Ltd.



Report No.: DNT2604171257R03055-04710

Date: May 14, 2026

Page: 114 / 132


NTHV	3DH5	Ant1	2402	30~1000	74.62	-78.02	≤-54	0.01578	≤4	PASS
NTLV	3DH5	Ant1	2402	1000~12500	3650.75	-62.98	≤-47	0.50350	≤20	PASS
NTNV	3DH5	Ant1	2402	1000~12500	3685.83	-62.76	≤-47	0.52966	≤20	PASS
NTHV	3DH5	Ant1	2402	1000~12500	3628.33	-62.94	≤-47	0.50816	≤20	PASS
NTLV	3DH5	Ant1	2441	30~1000	74.62	-78.62	≤-54	0.01374	≤4	PASS
NTNV	3DH5	Ant1	2441	30~1000	75.59	-79.08	≤-54	0.01236	≤4	PASS
NTHV	3DH5	Ant1	2441	30~1000	74.62	-78.32	≤-54	0.01472	≤4	PASS
NTLV	3DH5	Ant1	2441	1000~12500	3637.53	-62.98	≤-47	0.50350	≤20	PASS
NTNV	3DH5	Ant1	2441	1000~12500	3619.13	-62.97	≤-47	0.50466	≤20	PASS
NTHV	3DH5	Ant1	2441	1000~12500	4830.08	-62.39	≤-47	0.57677	≤20	PASS
NTLV	3DH5	Ant1	2480	30~1000	75.11	-78.77	≤-54	0.01327	≤4	PASS
NTNV	3DH5	Ant1	2480	30~1000	74.14	-78.07	≤-54	0.01560	≤4	PASS
NTHV	3DH5	Ant1	2480	30~1000	74.62	-79.26	≤-54	0.01186	≤4	PASS
NTLV	3DH5	Ant1	2480	1000~12500	3628.33	-63.11	≤-47	0.48865	≤20	PASS
NTNV	3DH5	Ant1	2480	1000~12500	5172.78	-59.79	≤-47	1.04954	≤20	PASS
NTHV	3DH5	Ant1	2480	1000~12500	3605.90	-63.22	≤-47	0.47643	≤20	PASS

Note: Both left and right earphone have tested, The right earphone is the worst, only the worse case was reported.




Test Graphs 1


NTLV-DH5-Ant1-2402-30~1000-PASS

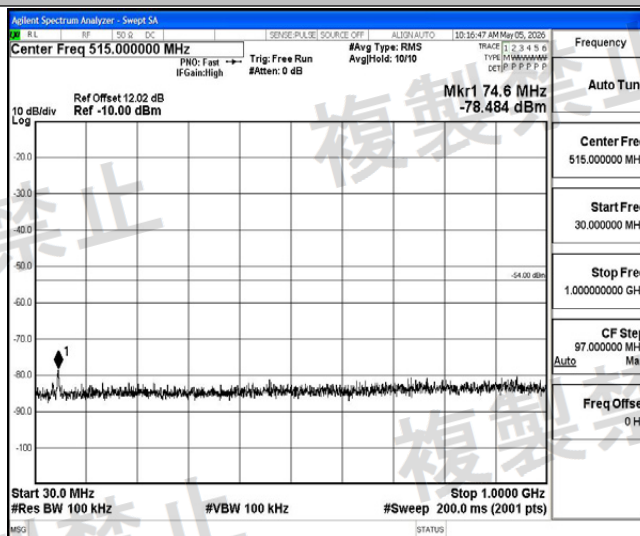

NTNV-DH5-Ant1-2402-30~1000-PASS

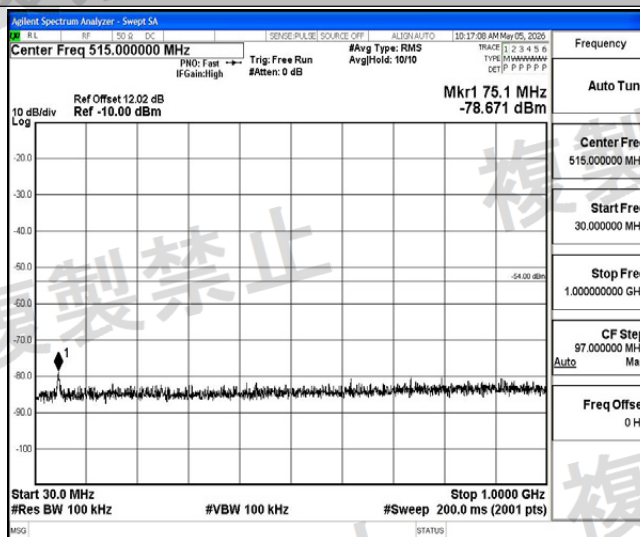


NTHV-DH5-Ant1-2402-30~1000-PASS

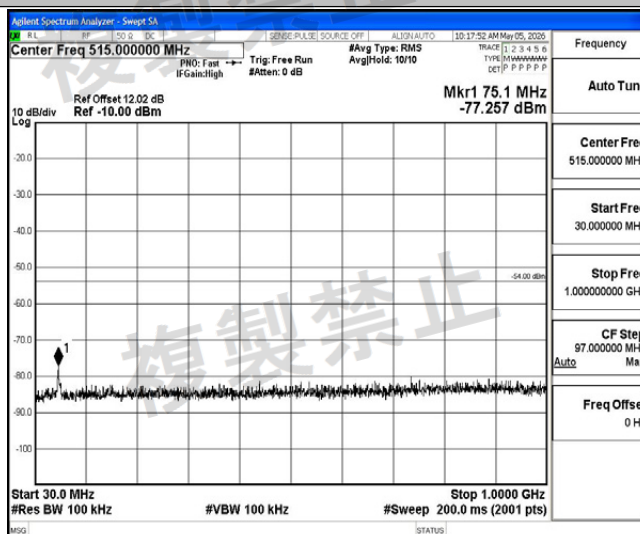


Dongguan DN Testing Co., Ltd.




NTLV-DH5-Ant1-2402-1000~12500-PASS

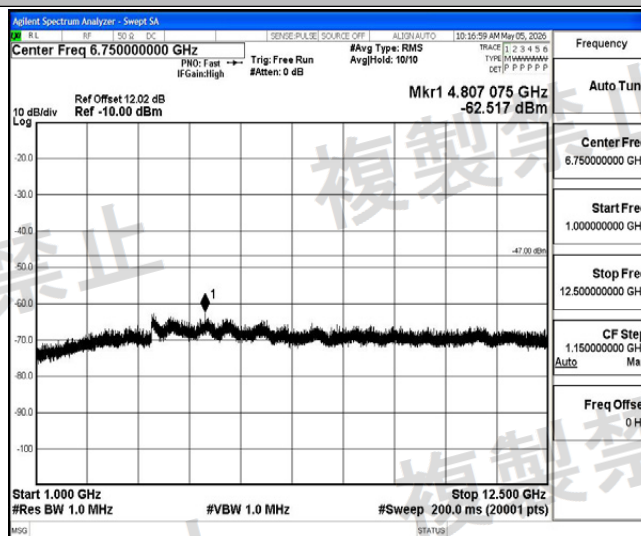

NTNV-DH5-Ant1-2402-1000~12500-See table below

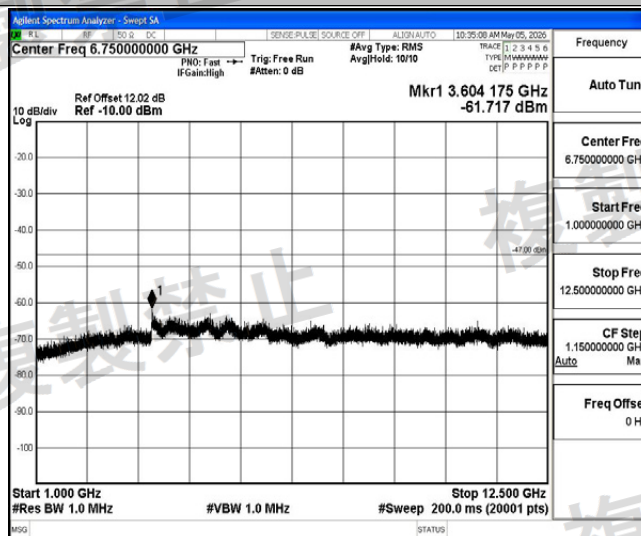


NTHV-DH5-Ant1-2402-1000~12500-PASS

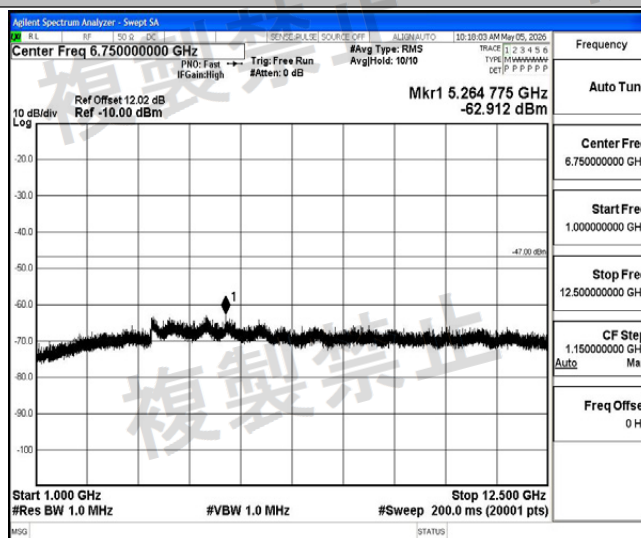


NTLV-DH5-Ant1-2441-30~1000-PASS


Dongguan DN Testing Co., Ltd.

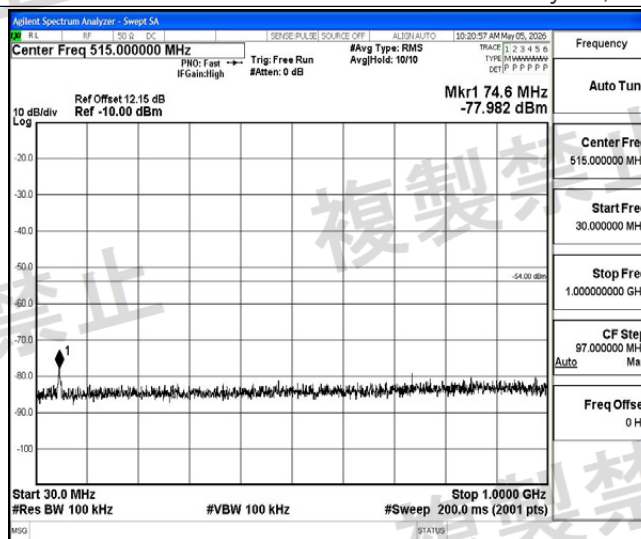


NTNV-DH5-Ant1-2441-30~1000-PASS

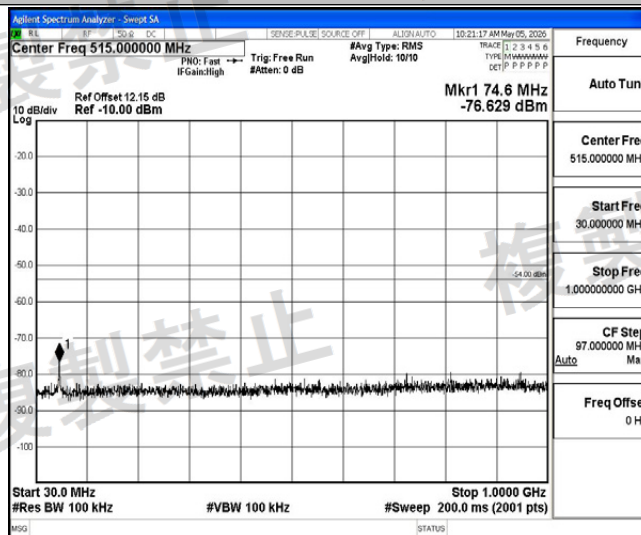


NTHV-DH5-Ant1-2441-30~1000-PASS

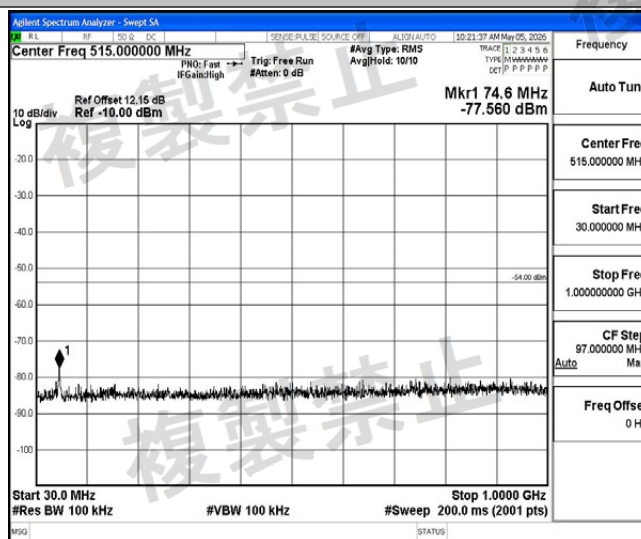


NTLV-DH5-Ant1-2441-1000~12500-PASS

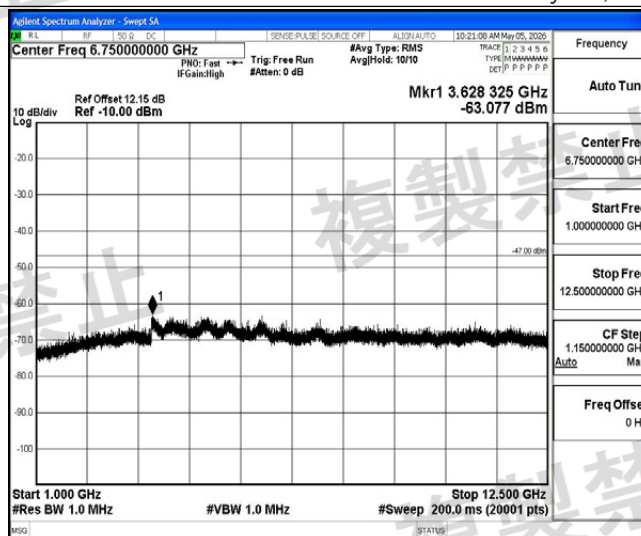


NTNV-DH5-Ant1-2441-1000~12500-PASS

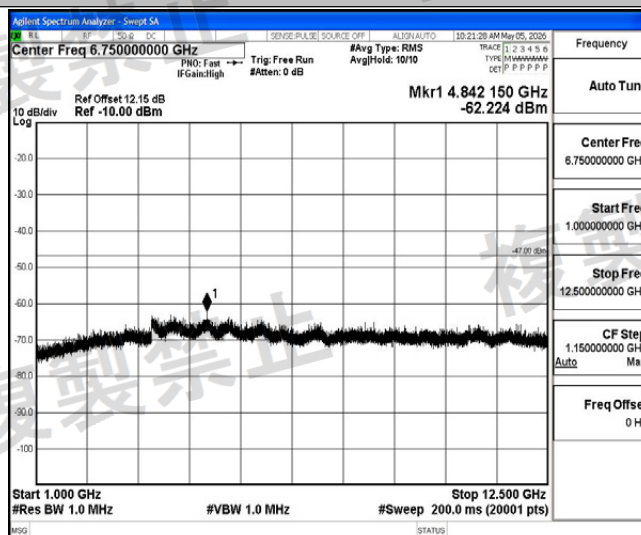


NTHV-DH5-Ant1-2441-1000~12500-PASS

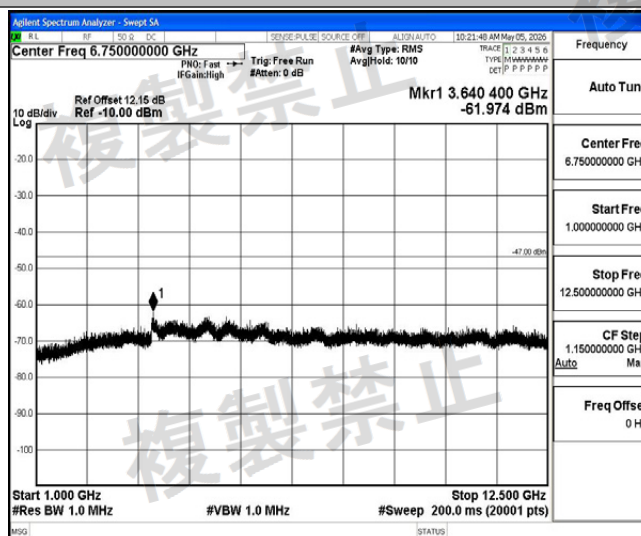


NTLV-DH5-Ant1-2480-30~1000-PASS

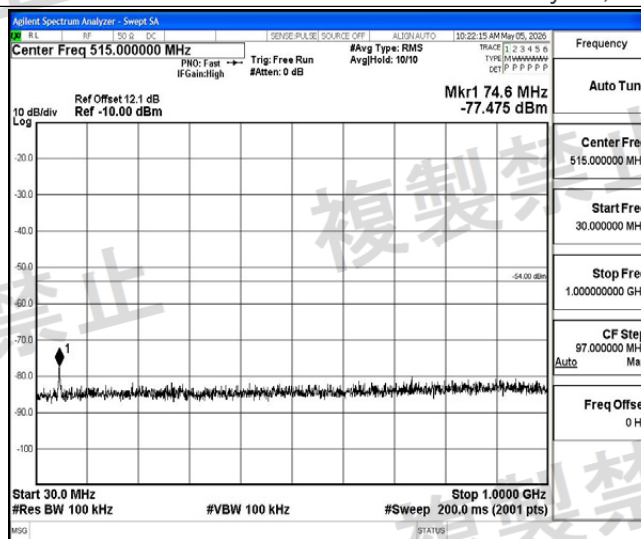


NTNV-DH5-Ant1-2480-30~1000-PASS

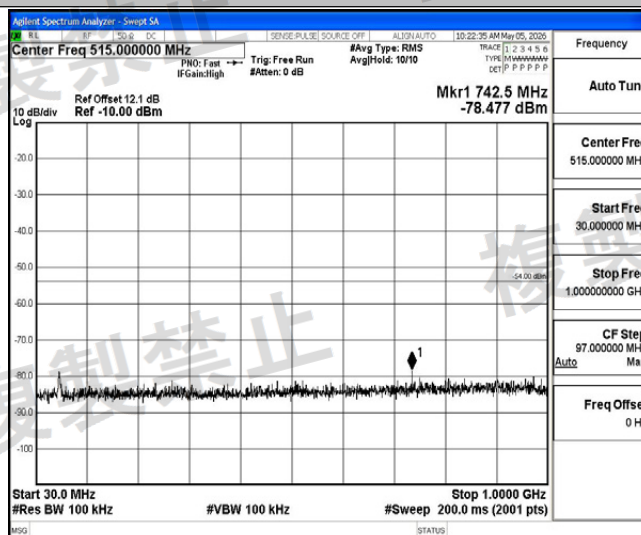


NTHV-DH5-Ant1-2480-30~1000-PASS

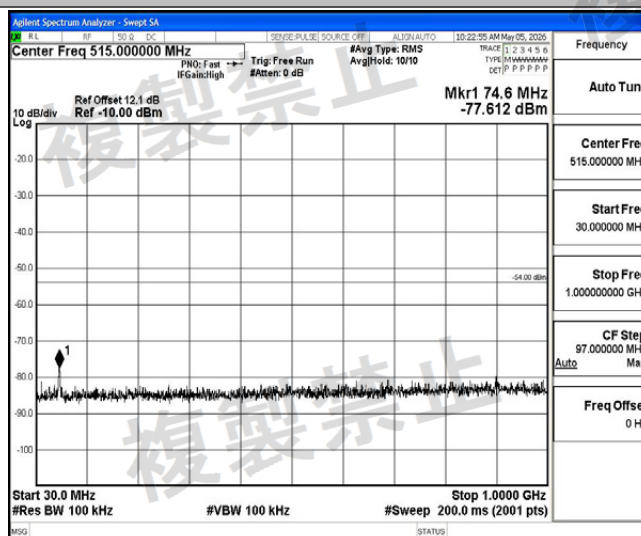


NTLV-DH5-Ant1-2480-1000~12500-PASS

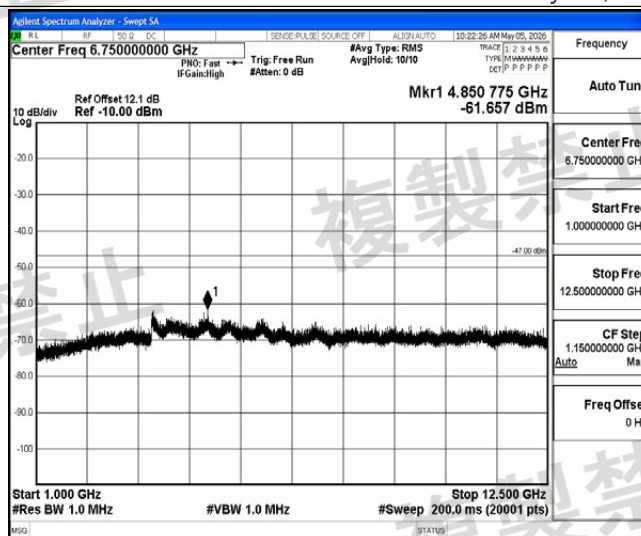


NTNV-DH5-Ant1-2480-1000~12500-PASS

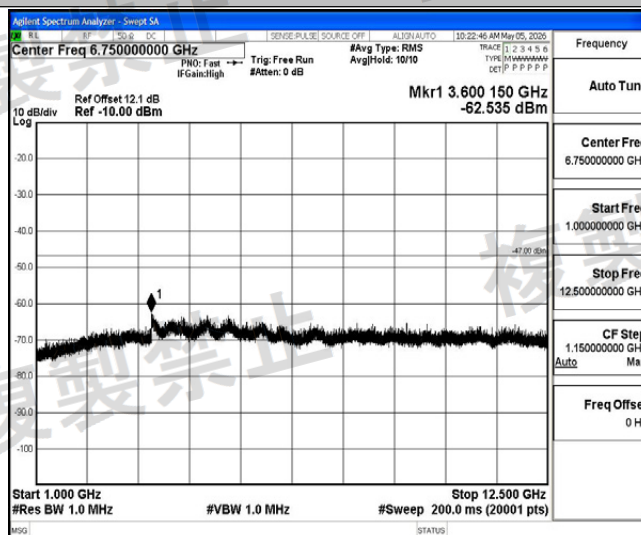


NTHV-DH5-Ant1-2480-1000~12500-PASS

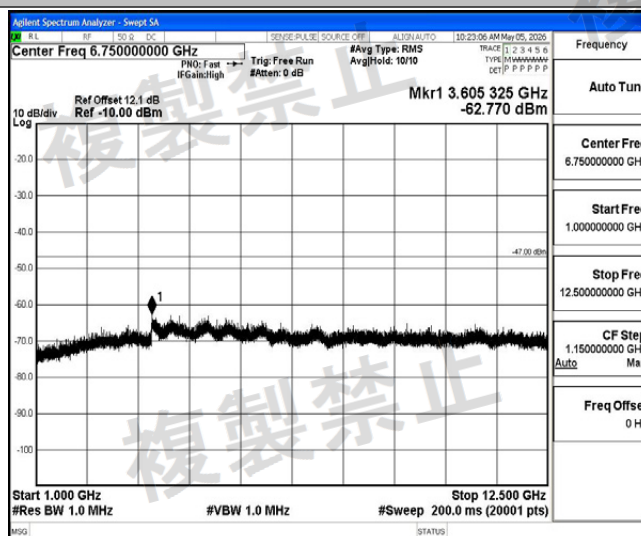


NTLV-2DH5-Ant1-2402-30~1000-PASS

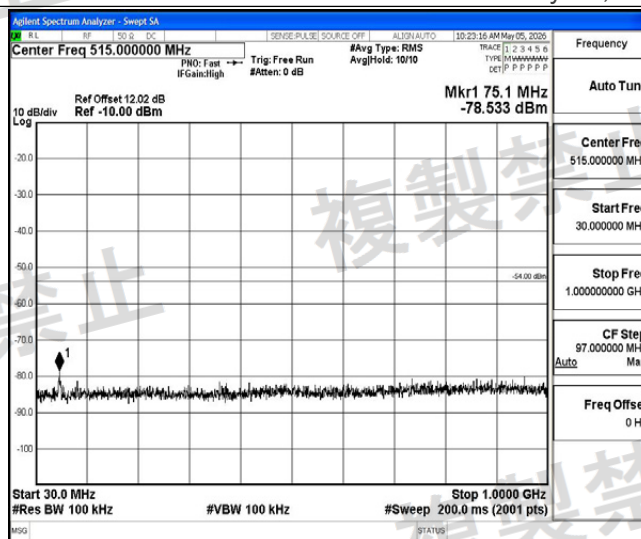


NTNV-2DH5-Ant1-2402-30~1000-PASS

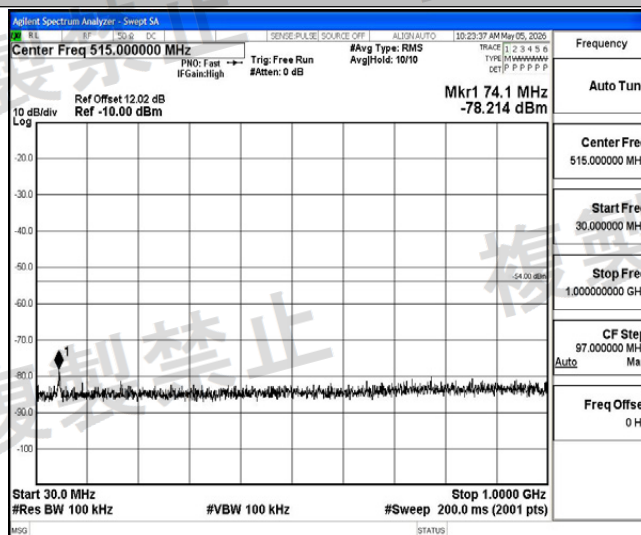


NTHV-2DH5-Ant1-2402-30~1000-PASS

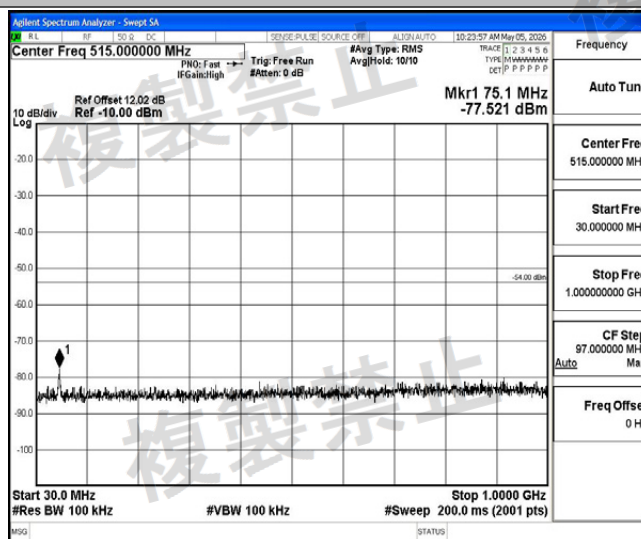


NTLV-2DH5-Ant1-2402-1000~12500-PASS

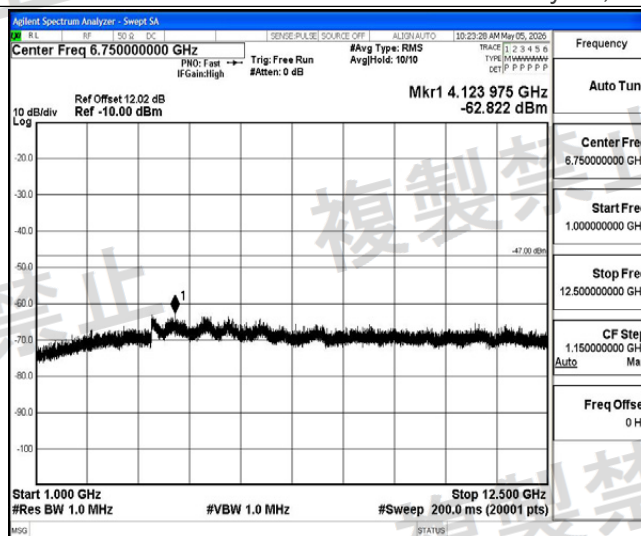


NTNV-2DH5-Ant1-2402-1000~12500-PASS

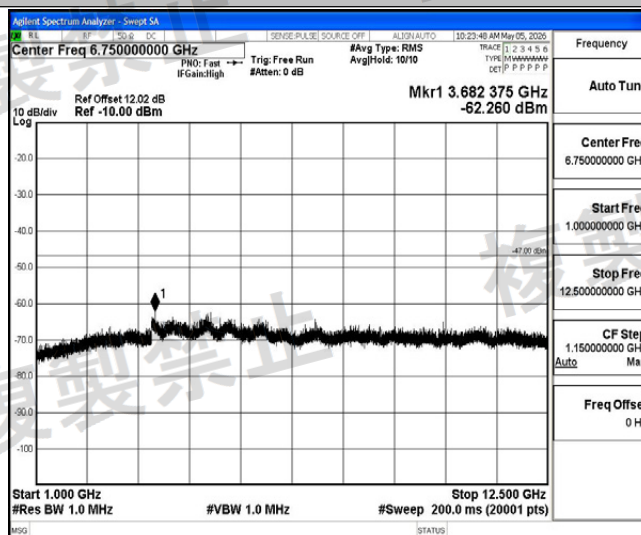


NTHV-2DH5-Ant1-2402-1000~12500-PASS

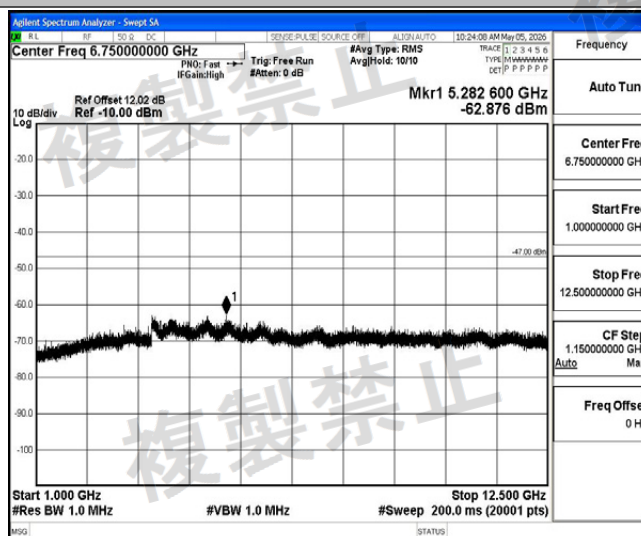


NTLV-2DH5-Ant1-2441-30~1000-PASS

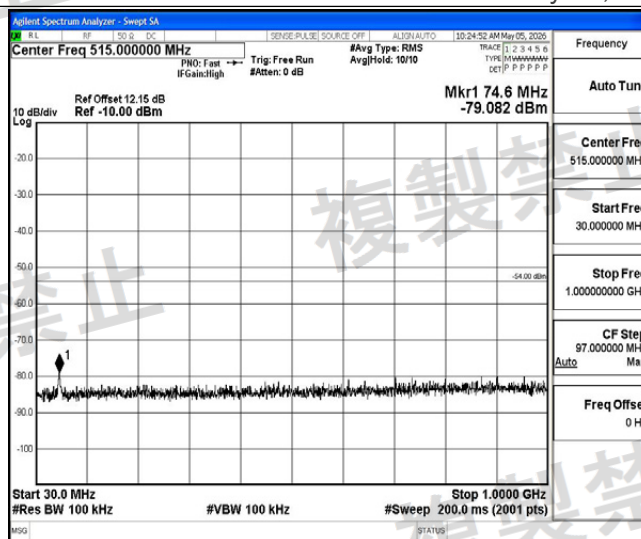


NTNV-2DH5-Ant1-2441-30~1000-PASS

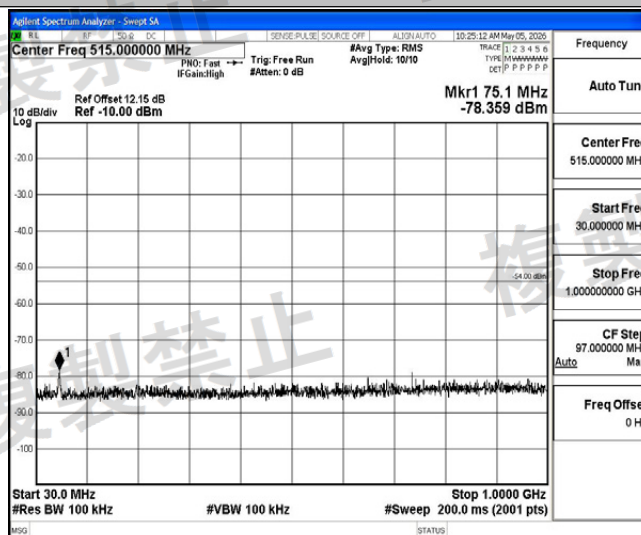


NTHV-2DH5-Ant1-2441-30~1000-PASS

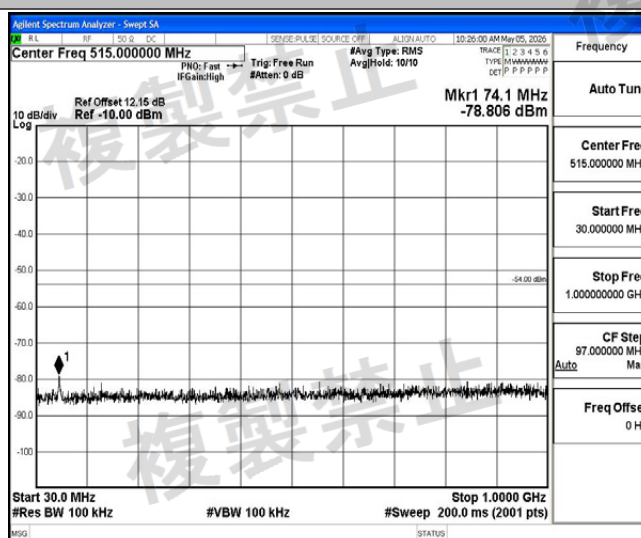


NTLV-2DH5-Ant1-2441-1000~12500-PASS

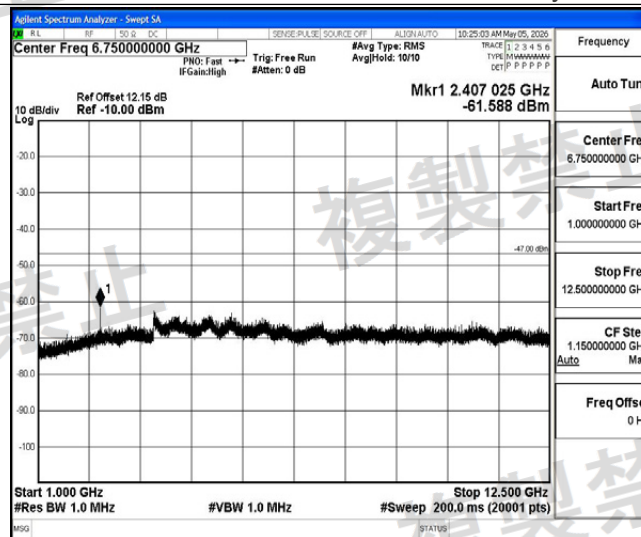


NTNV-2DH5-Ant1-2441-1000~12500-See table below

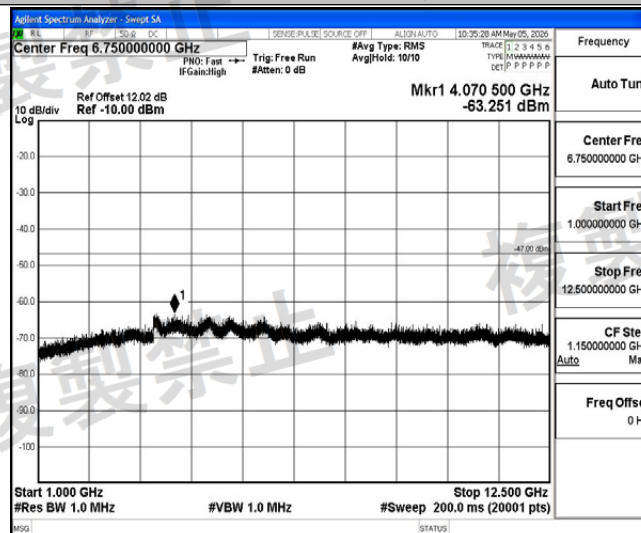


NTHV-2DH5-Ant1-2441-1000~12500-PASS

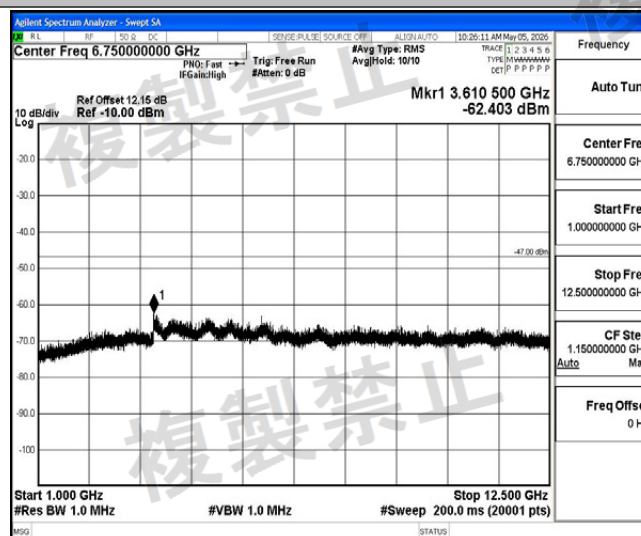


NTLV-2DH5-Ant1-2480-30~1000-PASS

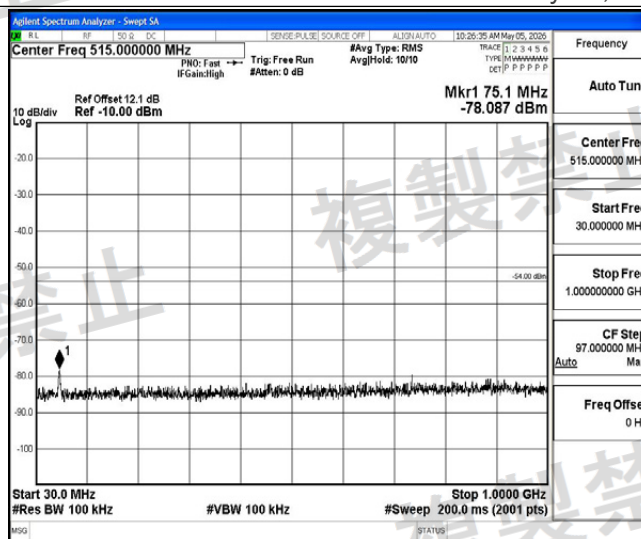


NTNV-2DH5-Ant1-2480-30~1000-PASS

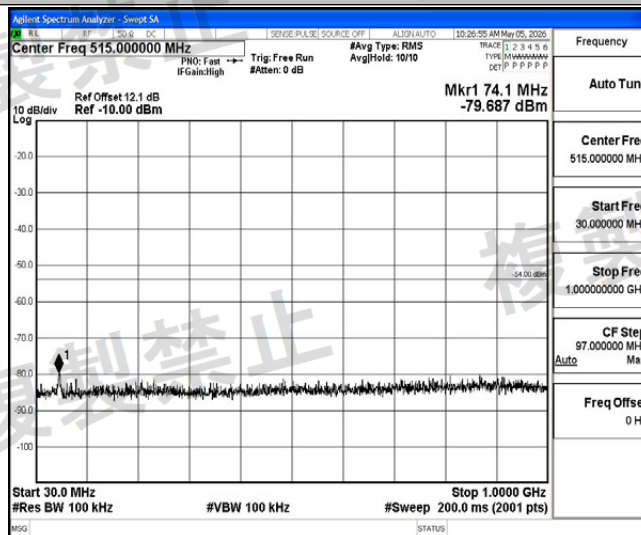


NTHV-2DH5-Ant1-2480-30~1000-PASS

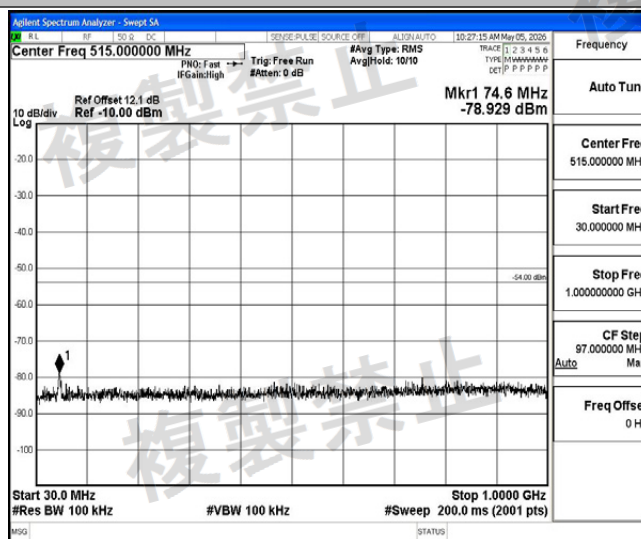


NTLV-2DH5-Ant1-2480-1000~12500-PASS

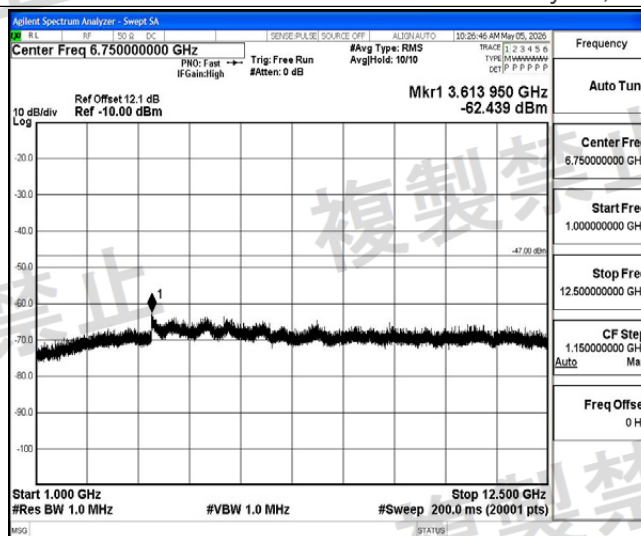


NTNV-2DH5-Ant1-2480-1000~12500-PASS

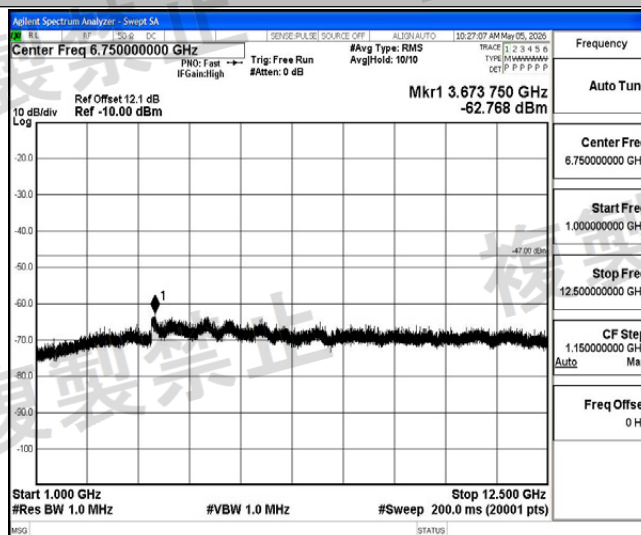


NTHV-2DH5-Ant1-2480-1000~12500-See table below

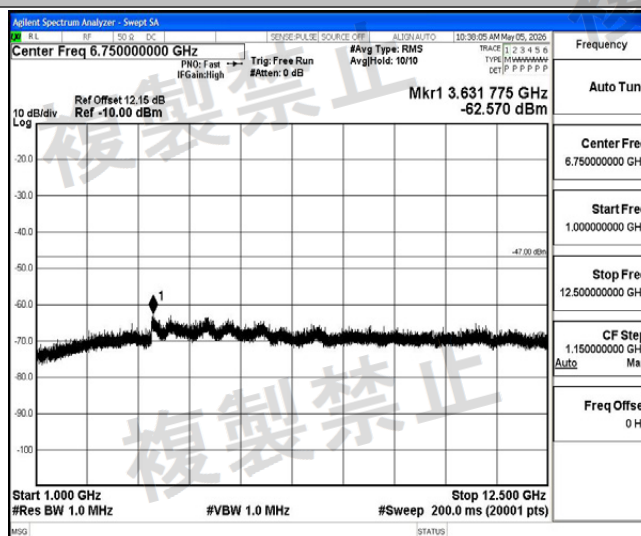


NTLV-3DH5-Ant1-2402-30~1000-PASS

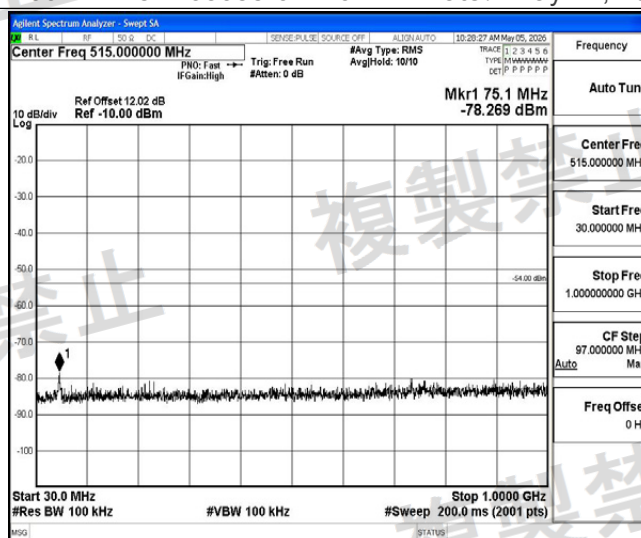


NTVN-3DH5-Ant1-2402-30~1000-PASS

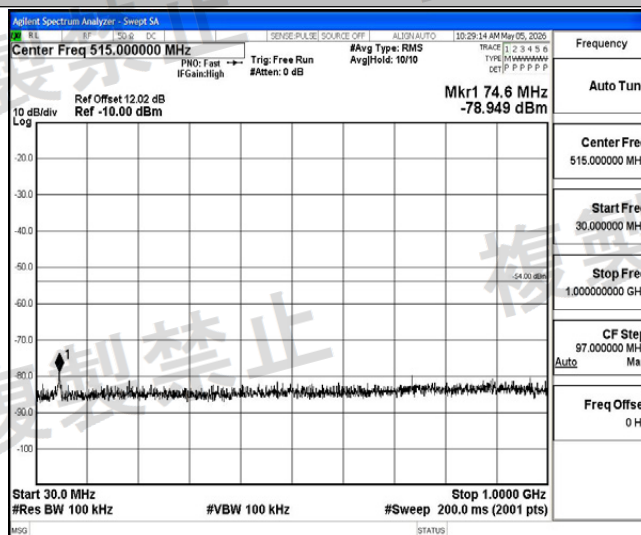


NTHV-3DH5-Ant1-2402-30~1000-PASS

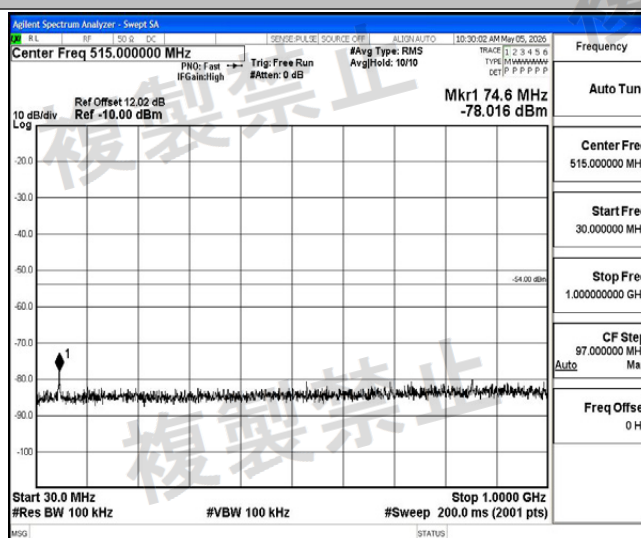


NTLV-3DH5-Ant1-2402-1000~12500-See table below

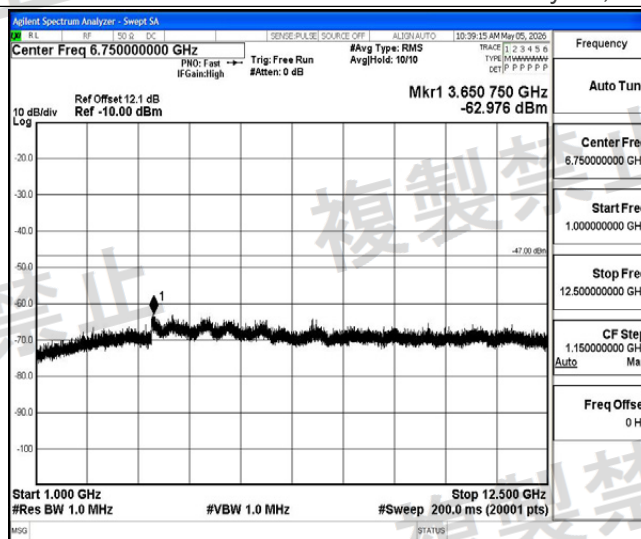


NTNV-3DH5-Ant1-2402-1000~12500-See table below

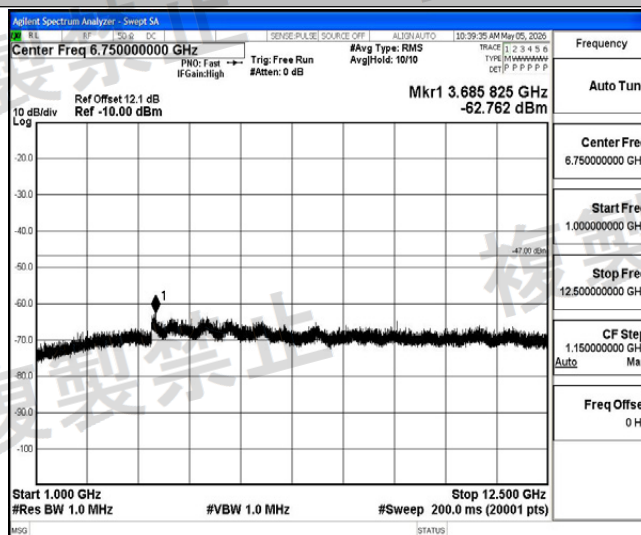


NTHV-3DH5-Ant1-2402-1000~12500-PASS

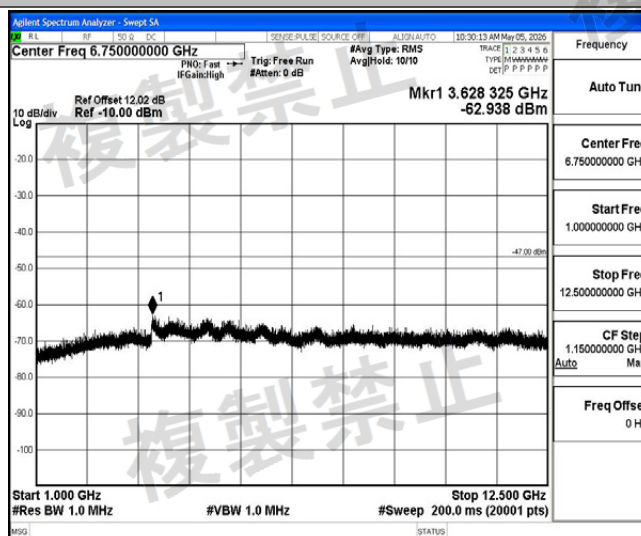


NTLV-3DH5-Ant1-2441-30~1000-PASS

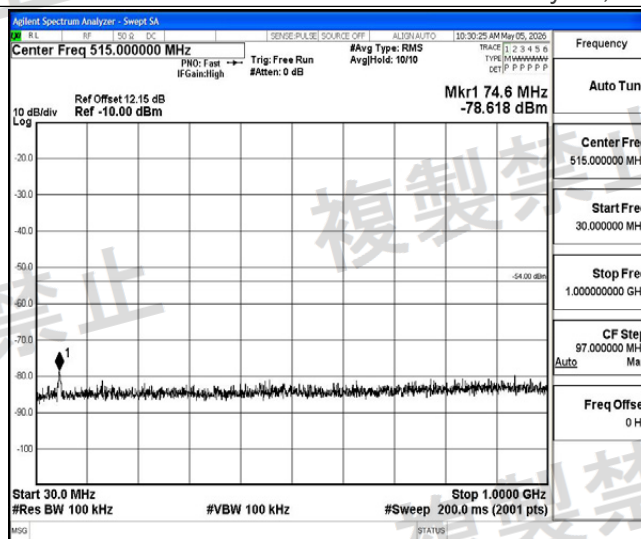


NTNV-3DH5-Ant1-2441-30~1000-PASS

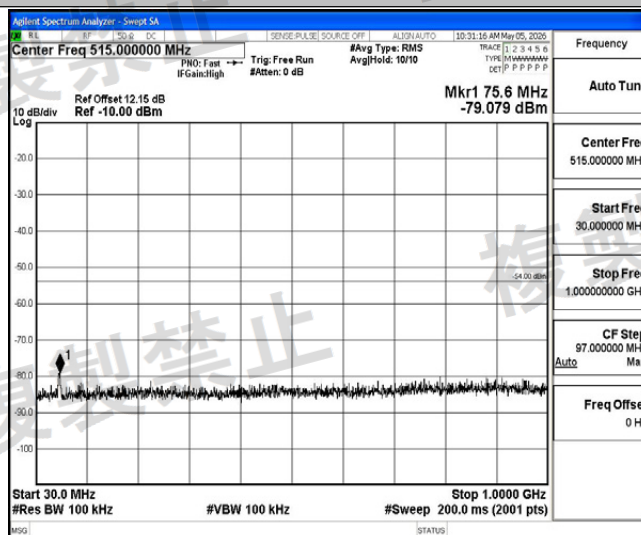


NTHV-3DH5-Ant1-2441-30~1000-PASS

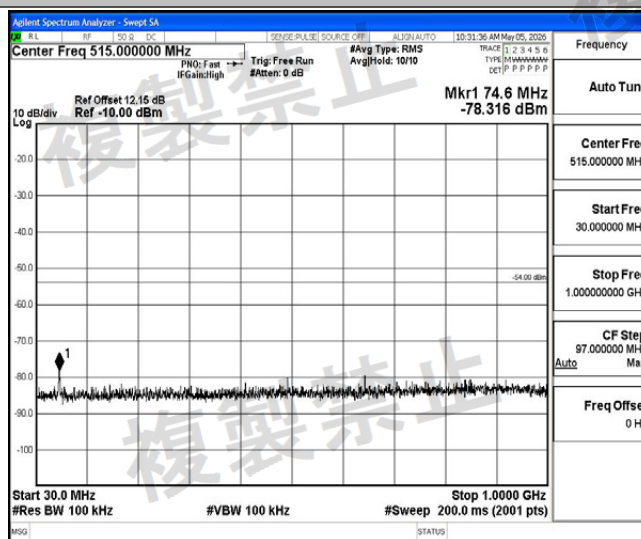


NTLV-3DH5-Ant1-2441-1000~12500-See table below

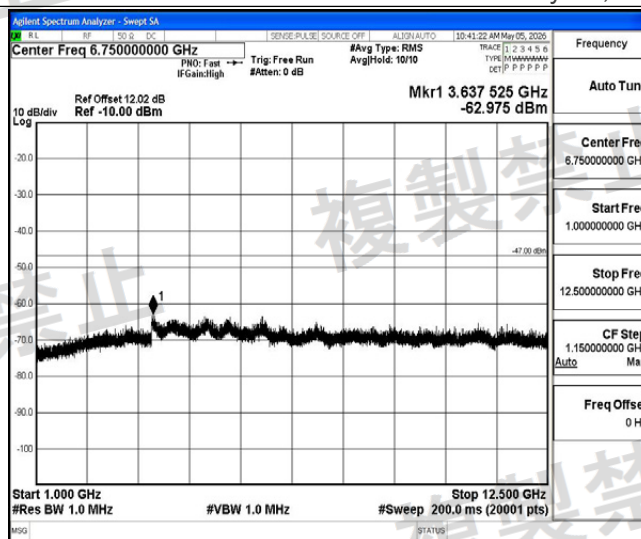


NTNV-3DH5-Ant1-2441-1000~12500-PASS

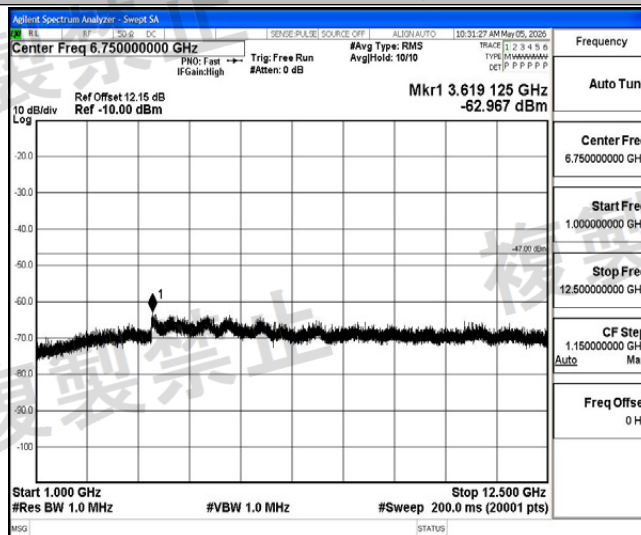


NTHV-3DH5-Ant1-2441-1000~12500-PASS

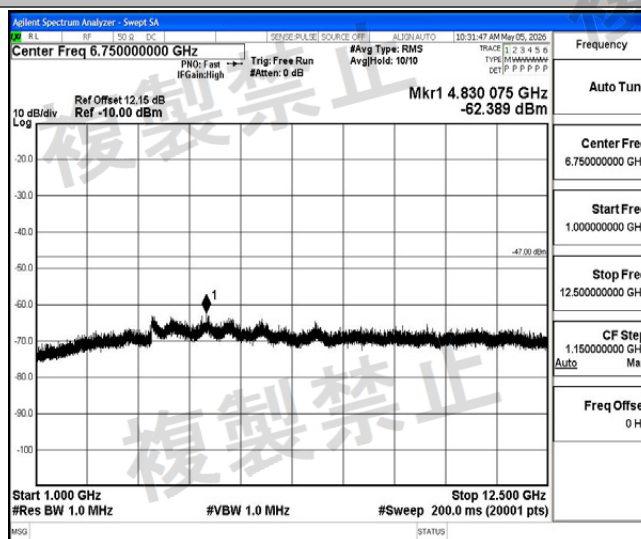


NTLV-3DH5-Ant1-2480-30~1000-PASS

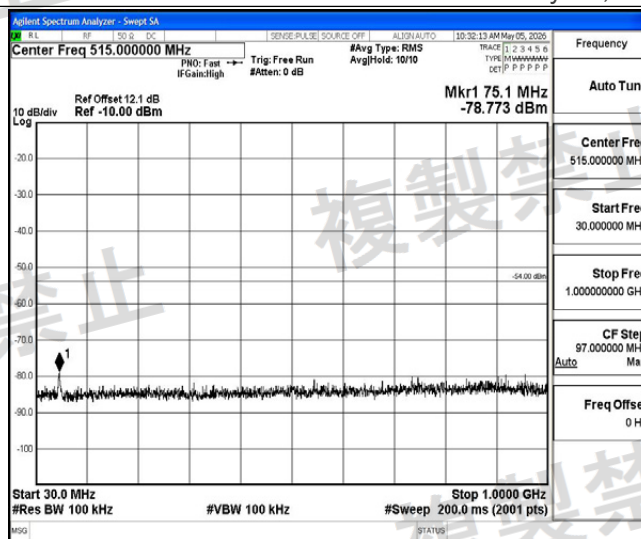


NTNV-3DH5-Ant1-2480-30~1000-PASS

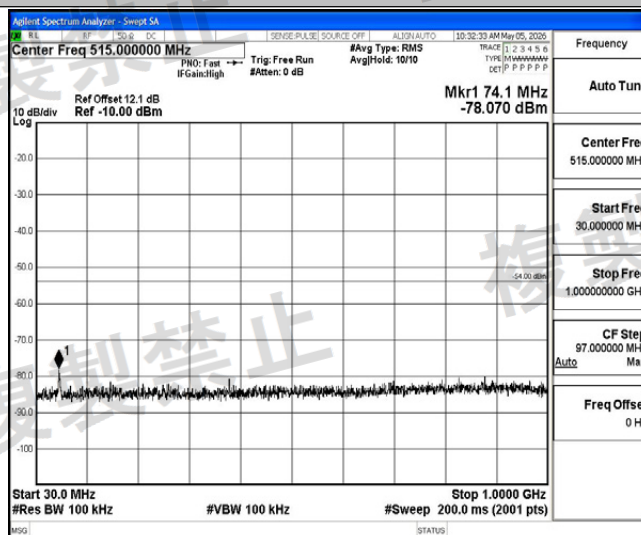


NTHV-3DH5-Ant1-2480-30~1000-PASS

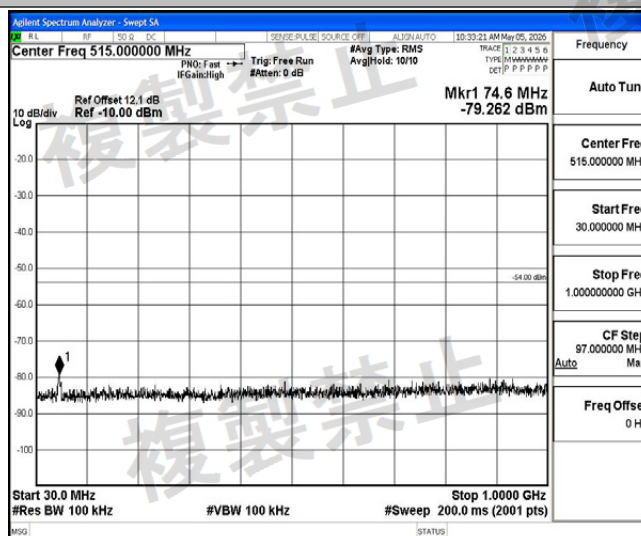


NTLV-3DH5-Ant1-2480-1000~12500-PASS

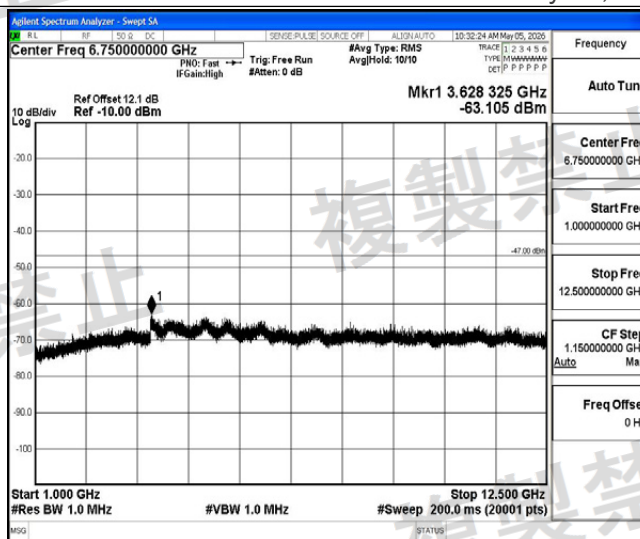

NTNV-3DH5-Ant1-2480-1000~12500-See table below

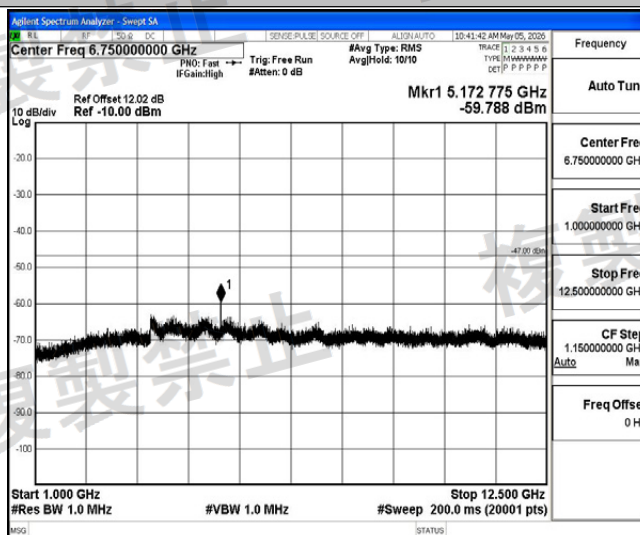

NTHV-3DH5-Ant1-2480-1000~12500-PASS

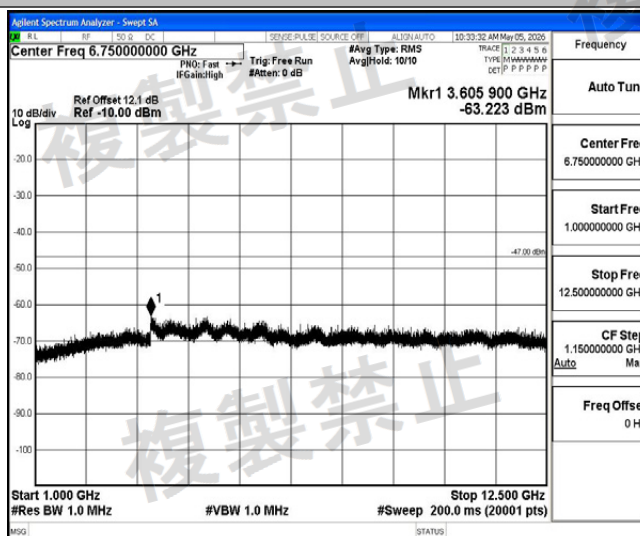

---END REPORT---

Dongguan DN Testing Co., Ltd.