






NTNV\_11AX40SISO\_Ant1\_5230\_5251~5270

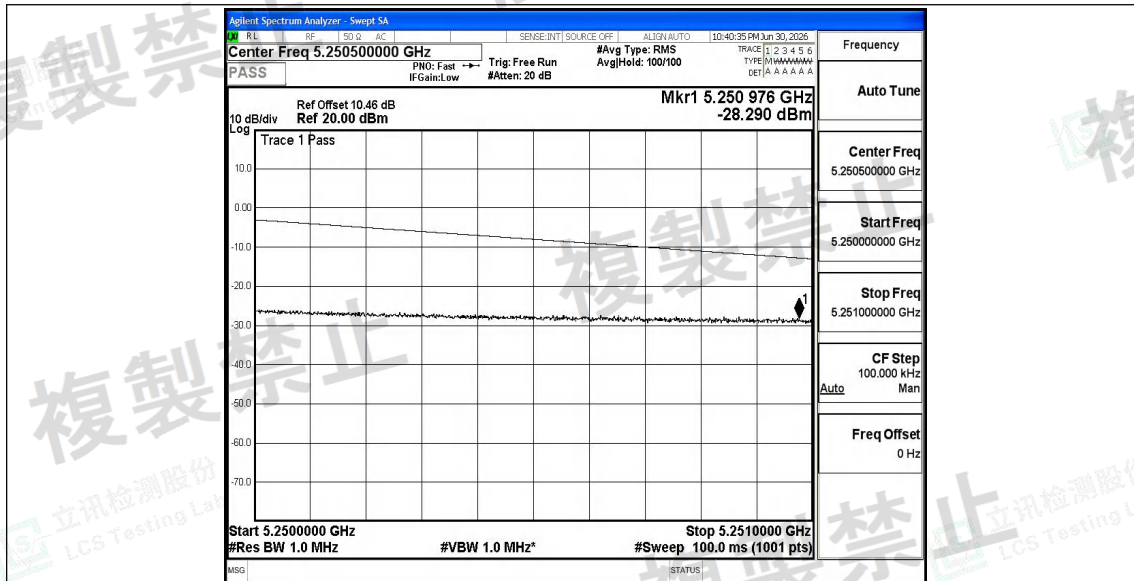


NTNV\_11AX40SISO\_Ant1\_5230\_5270~5278.4

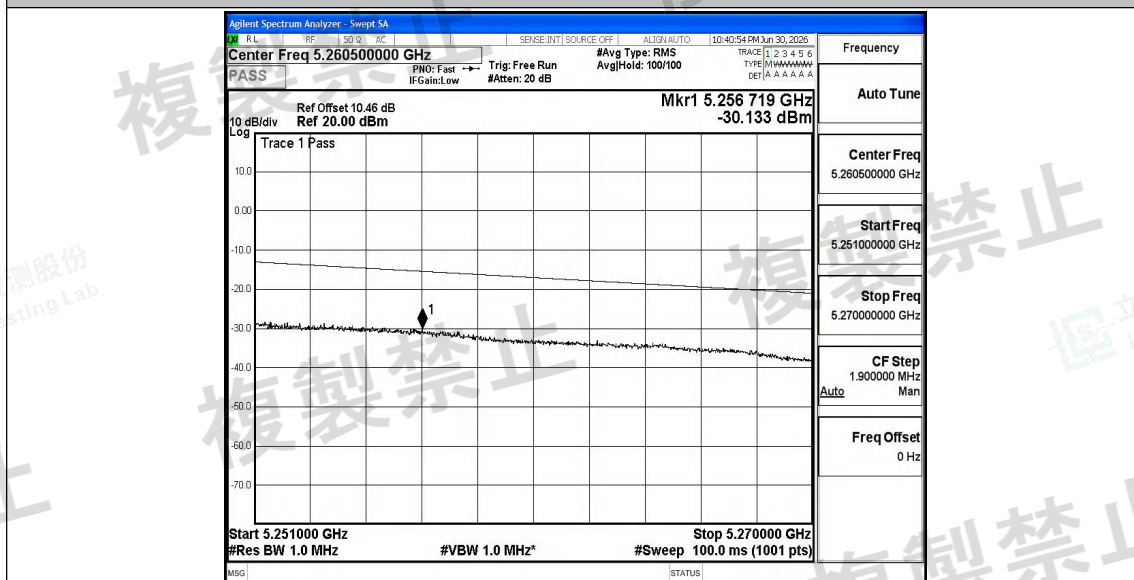

Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

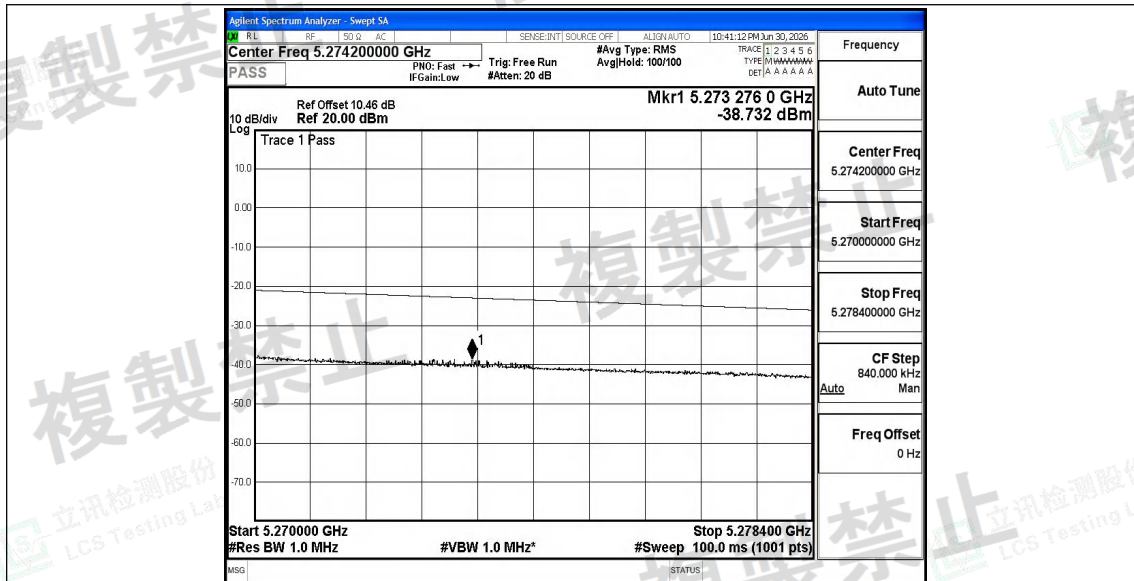


NTNV\_11AX40SISO\_Ant1\_5230\_5278.4~26000

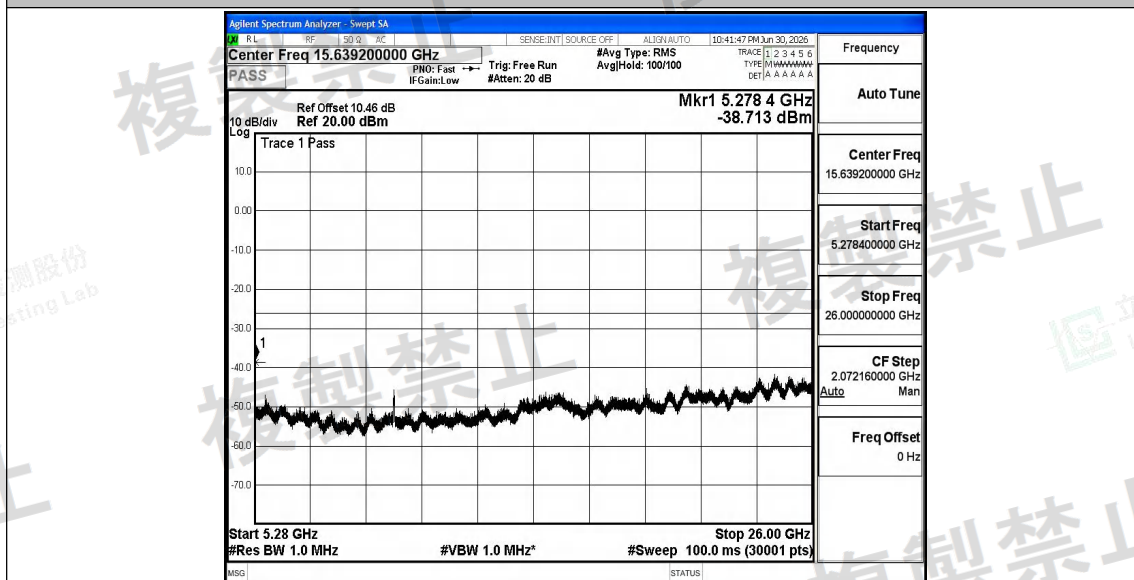


NTNV\_11AX80SISO\_Ant1\_5210\_30~5123.2



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

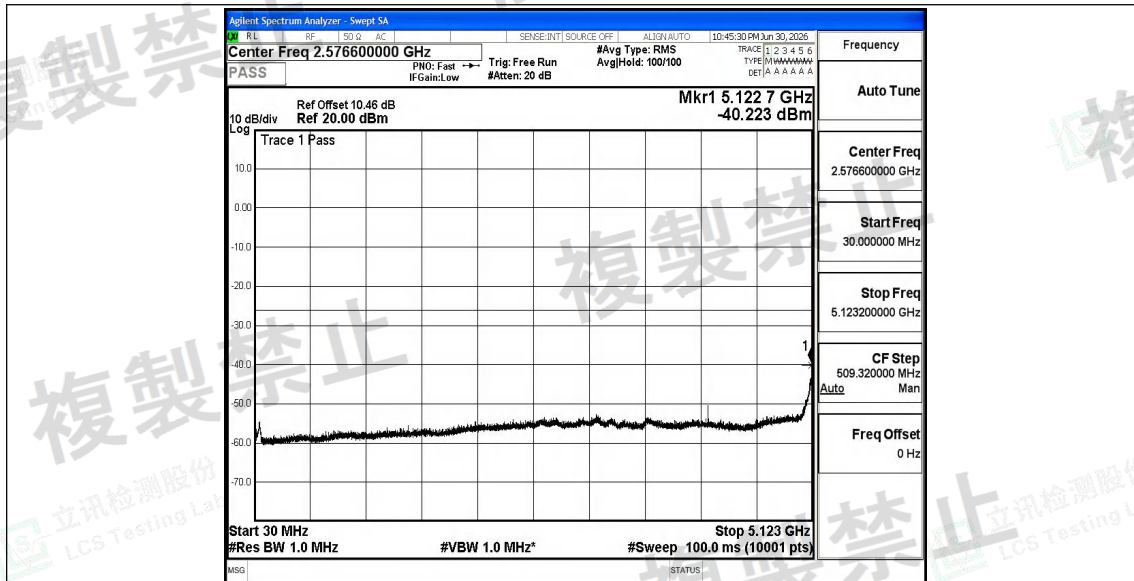


NTNV\_11AX80SISO\_Ant1\_5210\_5132.5~5150

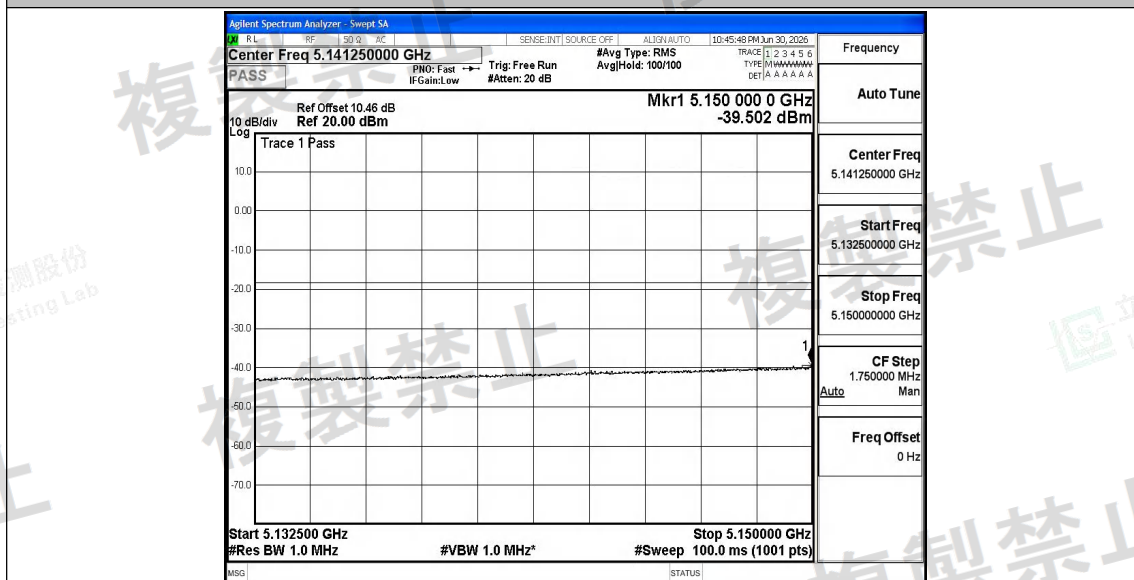


NTNV\_11AX80SISO\_Ant1\_5210\_5250~5251



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

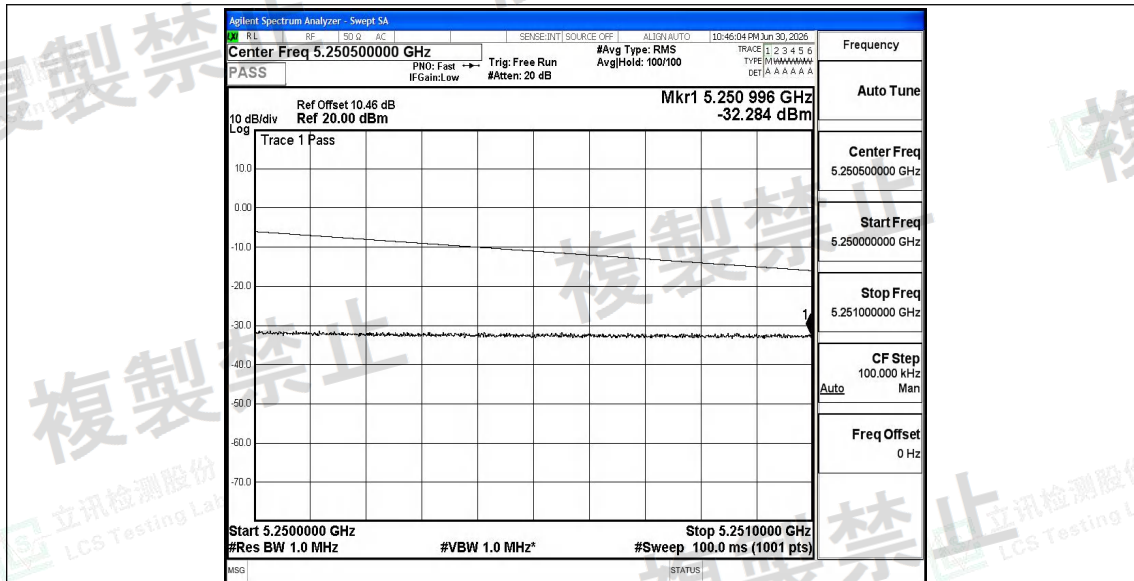


NTNV\_11AX80SISO\_Ant1\_5210\_5251~5290

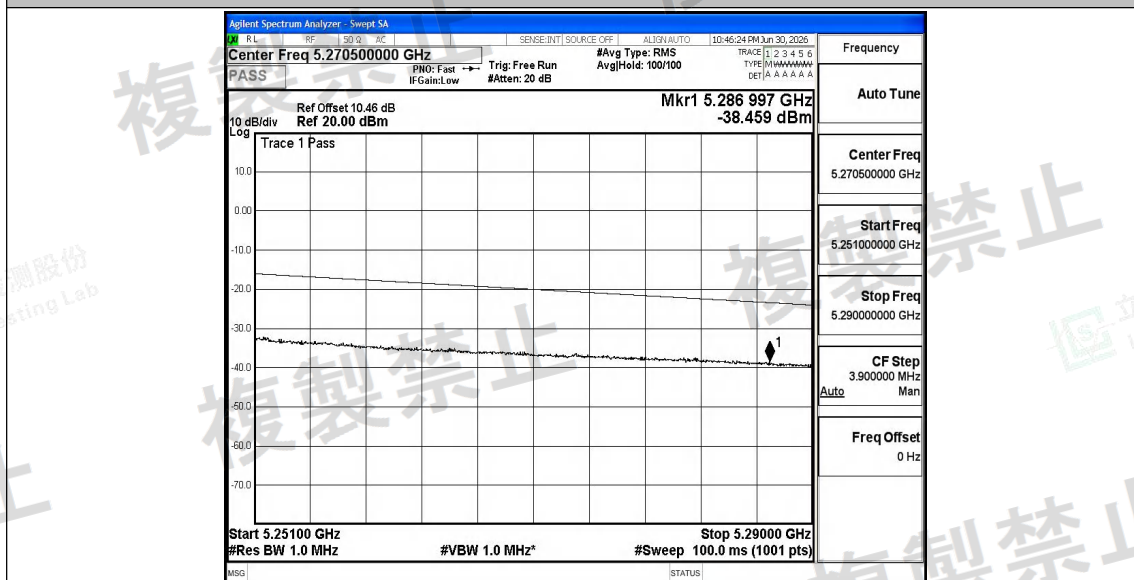

NTNV\_11AX80SISO\_Ant1\_5210\_5290~5296.7



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

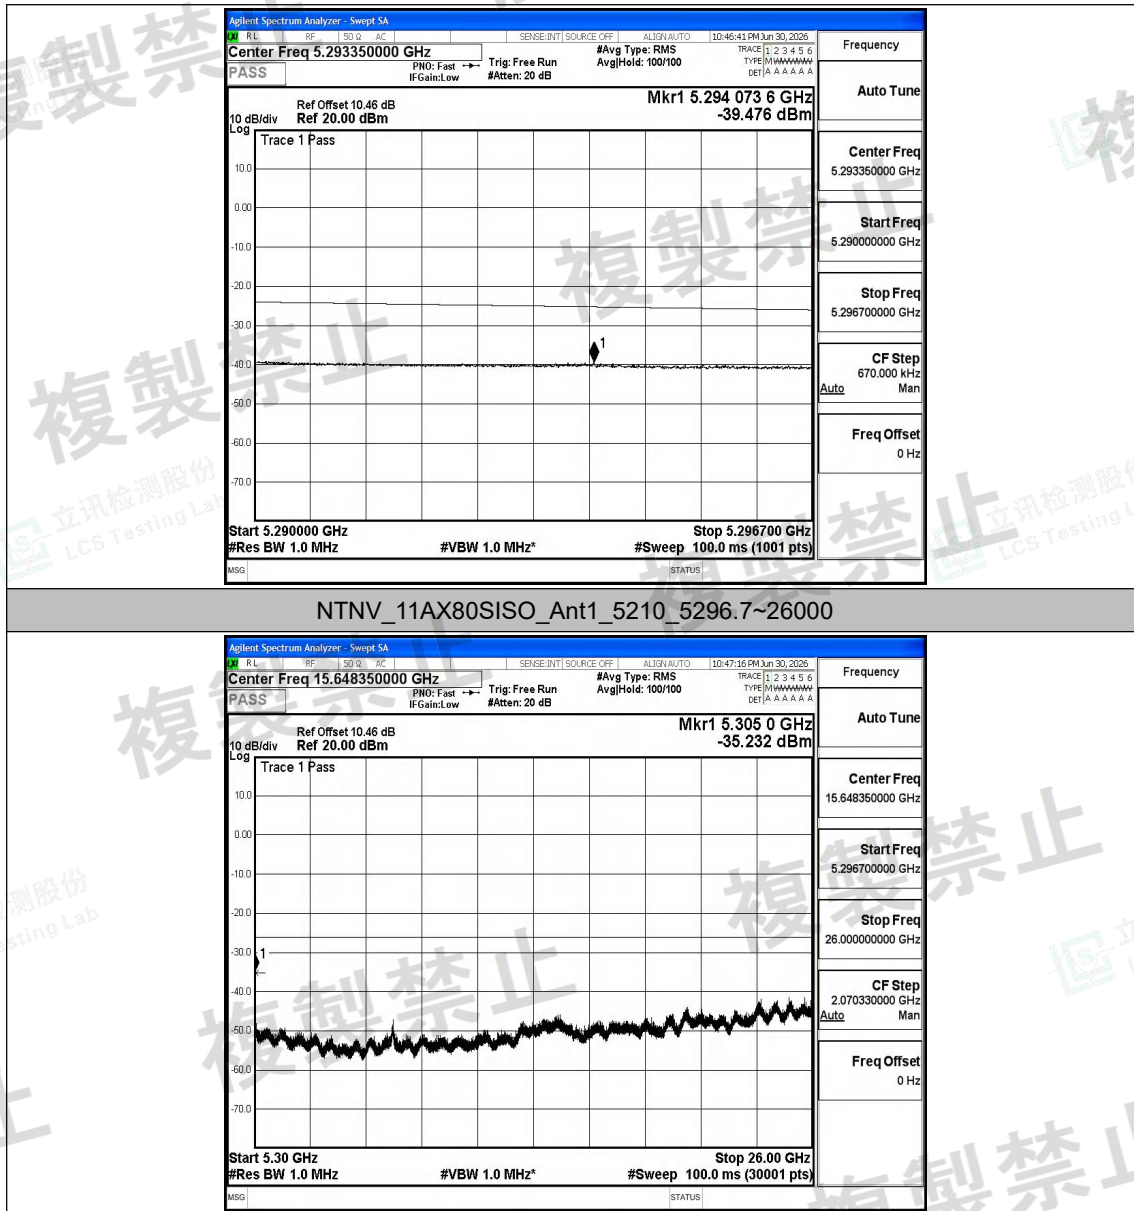

Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



## B.6 Spurious Emission of RX

### Test Result

| TestCondition | TestMode   | Antenna | Frequency[MHz] | Freq.Range [MHz] | Result [dBm] | Limit [dBm] | Result [nW] | Limit [nW] | Verdict |
|---------------|------------|---------|----------------|------------------|--------------|-------------|-------------|------------|---------|
| NTNV          | 11A        | Ant1    | 5180           | 30~1000          | -88.48       | ≤-54        | 0.000001419 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.77       | ≤-47        | 0.000419759 | ≤20        | PASS    |
|               |            |         | 5200           | 30~1000          | -87.98       | ≤-54        | 0.000001592 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.73       | ≤-47        | 0.000423643 | ≤20        | PASS    |
|               |            |         | 5240           | 30~1000          | -87.9        | ≤-54        | 0.000001622 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -64.04       | ≤-47        | 0.000394457 | ≤20        | PASS    |
|               | 11N20SISO  | Ant1    | 5180           | 30~1000          | -87.76       | ≤-54        | 0.000001675 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -62.98       | ≤-47        | 0.000503501 | ≤20        | PASS    |
|               |            |         | 5200           | 30~1000          | -88.3        | ≤-54        | 0.000001479 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.62       | ≤-47        | 0.000434510 | ≤20        | PASS    |
|               |            |         | 5240           | 30~1000          | -88.31       | ≤-54        | 0.000001476 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -64          | ≤-47        | 0.000398107 | ≤20        | PASS    |
|               | 11N40SISO  | Ant1    | 5190           | 30~1000          | -87.88       | ≤-54        | 0.000001629 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.62       | ≤-47        | 0.000434510 | ≤20        | PASS    |
|               |            |         | 5230           | 30~1000          | -88.2        | ≤-54        | 0.000001514 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.04       | ≤-47        | 0.000496592 | ≤20        | PASS    |
|               | 11AC20SISO | Ant1    | 5180           | 30~1000          | -88.25       | ≤-54        | 0.000001496 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.57       | ≤-47        | 0.000439542 | ≤20        | PASS    |
|               |            |         | 5200           | 30~1000          | -87.78       | ≤-54        | 0.000001667 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.69       | ≤-47        | 0.000427563 | ≤20        | PASS    |
|               |            |         | 5240           | 30~1000          | -88.26       | ≤-54        | 0.000001493 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.38       | ≤-47        | 0.000459198 | ≤20        | PASS    |
|               | 11AC40SISO | Ant1    | 5190           | 30~1000          | -88.06       | ≤-54        | 0.000001563 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.72       | ≤-47        | 0.000424620 | ≤20        | PASS    |
|               |            |         | 5230           | 30~1000          | -88.19       | ≤-54        | 0.000001517 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -64.2        | ≤-47        | 0.000380189 | ≤20        | PASS    |
|               | 11AC80SISO | Ant1    | 5210           | 30~1000          | -87.77       | ≤-54        | 0.000001671 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.18       | ≤-47        | 0.000480839 | ≤20        | PASS    |
|               | 11AX20SISO | Ant1    | 5180           | 30~1000          | -88.19       | ≤-54        | 0.000001517 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.39       | ≤-47        | 0.000458142 | ≤20        | PASS    |
|               |            |         | 5200           | 30~1000          | -88.25       | ≤-54        | 0.000001496 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.21       | ≤-47        | 0.000477529 | ≤20        | PASS    |
|               |            |         | 5240           | 30~1000          | -88.03       | ≤-54        | 0.000001574 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.69       | ≤-47        | 0.000427563 | ≤20        | PASS    |
|               | 11AX40SISO | Ant1    | 5190           | 30~1000          | -88.38       | ≤-54        | 0.000001452 | ≤4         | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|  |            |      |      |            |        |      |             |     |      |
|--|------------|------|------|------------|--------|------|-------------|-----|------|
|  | 11AX80SISO | Ant1 | 5230 | 1000~26000 | -64.08 | ≤-47 | 0.000390841 | ≤20 | PASS |
|  |            |      |      | 30~1000    | -87.82 | ≤-54 | 0.000001652 | ≤4  | PASS |
|  |            |      | 5210 | 1000~26000 | -64.14 | ≤-47 | 0.000385478 | ≤20 | PASS |
|  |            |      |      | 30~1000    | -87.71 | ≤-54 | 0.000001694 | ≤4  | PASS |
|  | 11AX80SISO | Ant1 | 5210 | 1000~26000 | -63.36 | ≤-47 | 0.000461318 | ≤20 | PASS |
|  |            |      |      | 30~1000    | -87.71 | ≤-54 | 0.000001694 | ≤4  | PASS |

| TestCondition | TestMode   | Antenna | Frequency[MHz] | Freq.Range [MHz] | Result [dBm] | Limit [dBm] | Result [nW] | Limit [nW] | Verdict |
|---------------|------------|---------|----------------|------------------|--------------|-------------|-------------|------------|---------|
| NTHV          | 11A        | Ant1    | 5180           | 30~1000          | -88.53       | ≤-54        | 0.000001403 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.81       | ≤-47        | 0.000415911 | ≤20        | PASS    |
|               |            |         | 5200           | 30~1000          | -88.01       | ≤-54        | 0.000001581 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.79       | ≤-47        | 0.000417830 | ≤20        | PASS    |
|               |            |         | 5240           | 30~1000          | -87.95       | ≤-54        | 0.000001603 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -64.09       | ≤-47        | 0.000389942 | ≤20        | PASS    |
|               | 11N20SISO  | Ant1    | 5180           | 30~1000          | -87.87       | ≤-54        | 0.000001633 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.03       | ≤-47        | 0.000497737 | ≤20        | PASS    |
|               |            |         | 5200           | 30~1000          | -88.36       | ≤-54        | 0.000001459 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.66       | ≤-47        | 0.000430527 | ≤20        | PASS    |
|               |            |         | 5240           | 30~1000          | -88.35       | ≤-54        | 0.000001462 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -64.05       | ≤-47        | 0.000393550 | ≤20        | PASS    |
|               | 11N40SISO  | Ant1    | 5190           | 30~1000          | -87.93       | ≤-54        | 0.000001611 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.69       | ≤-47        | 0.000427563 | ≤20        | PASS    |
|               |            |         | 5230           | 30~1000          | -88.27       | ≤-54        | 0.000001489 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.11       | ≤-47        | 0.000488652 | ≤20        | PASS    |
|               | 11AC20SISO | Ant1    | 5180           | 30~1000          | -88.29       | ≤-54        | 0.000001483 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.63       | ≤-47        | 0.000433511 | ≤20        | PASS    |
|               |            |         | 5200           | 30~1000          | -87.82       | ≤-54        | 0.000001652 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.72       | ≤-47        | 0.000424620 | ≤20        | PASS    |
|               |            |         | 5240           | 30~1000          | -88.29       | ≤-54        | 0.000001483 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.42       | ≤-47        | 0.000454988 | ≤20        | PASS    |
|               | 11AC40SISO | Ant1    | 5190           | 30~1000          | -88.15       | ≤-54        | 0.000001531 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.78       | ≤-47        | 0.000418794 | ≤20        | PASS    |
|               |            |         | 5230           | 30~1000          | -88.35       | ≤-54        | 0.000001462 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -64.26       | ≤-47        | 0.000374973 | ≤20        | PASS    |
|               | 11AC80SISO | Ant1    | 5210           | 30~1000          | -87.82       | ≤-54        | 0.000001652 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.23       | ≤-47        | 0.000475335 | ≤20        | PASS    |
|               | 11AX20SISO | Ant1    | 5180           | 30~1000          | -88.25       | ≤-54        | 0.000001496 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.42       | ≤-47        | 0.000454988 | ≤20        | PASS    |
|               | 11AX20SISO | Ant1    | 5200           | 30~1000          | -88.37       | ≤-54        | 0.000001455 | ≤4         | PASS    |
|               |            |         |                | 30~1000          | -88.37       | ≤-54        | 0.000001455 | ≤4         | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|  |            |      |      |            |        |      |             |     |      |
|--|------------|------|------|------------|--------|------|-------------|-----|------|
|  |            |      | 5240 | 1000~26000 | -63.29 | ≤-47 | 0.000468813 | ≤20 | PASS |
|  |            |      |      | 30~1000    | -88.14 | ≤-54 | 0.000001535 | ≤4  | PASS |
|  |            |      |      | 1000~26000 | -63.72 | ≤-47 | 0.000424620 | ≤20 | PASS |
|  | 11AX40SISO | Ant1 | 5190 | 30~1000    | -88.45 | ≤-54 | 0.000001429 | ≤4  | PASS |
|  |            |      |      | 1000~26000 | -64.13 | ≤-47 | 0.000386367 | ≤20 | PASS |
|  |            |      | 5230 | 30~1000    | -87.98 | ≤-54 | 0.000001592 | ≤4  | PASS |
|  |            |      |      | 1000~26000 | -64.26 | ≤-47 | 0.000374973 | ≤20 | PASS |
|  | 11AX80SISO | Ant1 | 5210 | 30~1000    | -87.84 | ≤-54 | 0.000001644 | ≤4  | PASS |
|  |            |      |      | 1000~26000 | -63.44 | ≤-47 | 0.000452898 | ≤20 | PASS |

| TestCondition | TestMode   | Antenna | Frequency[MHz] | Freq.Range [MHz] | Result [dBm] | Limit [dBm] | Result [nW] | Limit [nW] | Verdict |
|---------------|------------|---------|----------------|------------------|--------------|-------------|-------------|------------|---------|
| NTLV          | 11A        | Ant1    | 5180           | 30~1000          | -88.58       | ≤-54        | 0.000001387 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.86       | ≤-47        | 0.000411150 | ≤20        | PASS    |
|               |            |         | 5200           | 30~1000          | -88.06       | ≤-54        | 0.000001563 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.82       | ≤-47        | 0.000414954 | ≤20        | PASS    |
|               |            |         | 5240           | 30~1000          | -87.99       | ≤-54        | 0.000001589 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -64.12       | ≤-47        | 0.000387258 | ≤20        | PASS    |
|               | 11N20SISO  | Ant1    | 5180           | 30~1000          | -87.92       | ≤-54        | 0.000001614 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.06       | ≤-47        | 0.000494311 | ≤20        | PASS    |
|               |            |         | 5200           | 30~1000          | -88.42       | ≤-54        | 0.000001439 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.69       | ≤-47        | 0.000427563 | ≤20        | PASS    |
|               |            |         | 5240           | 30~1000          | -88.42       | ≤-54        | 0.000001439 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -64.12       | ≤-47        | 0.000387258 | ≤20        | PASS    |
|               | 11N40SISO  | Ant1    | 5190           | 30~1000          | -87.99       | ≤-54        | 0.000001589 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.72       | ≤-47        | 0.000424620 | ≤20        | PASS    |
|               |            |         | 5230           | 30~1000          | -88.35       | ≤-54        | 0.000001462 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.16       | ≤-47        | 0.000483059 | ≤20        | PASS    |
|               | 11AC20SISO | Ant1    | 5180           | 30~1000          | -88.34       | ≤-54        | 0.000001466 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.71       | ≤-47        | 0.000425598 | ≤20        | PASS    |
|               |            |         | 5200           | 30~1000          | -87.86       | ≤-54        | 0.000001637 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.75       | ≤-47        | 0.000421697 | ≤20        | PASS    |
|               |            |         | 5240           | 30~1000          | -88.36       | ≤-54        | 0.000001459 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.46       | ≤-47        | 0.000450817 | ≤20        | PASS    |
|               | 11AC40SISO | Ant1    | 5190           | 30~1000          | -88.19       | ≤-54        | 0.000001517 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -63.82       | ≤-47        | 0.000414954 | ≤20        | PASS    |
|               |            |         | 5230           | 30~1000          | -88.43       | ≤-54        | 0.000001435 | ≤4         | PASS    |
|               |            |         |                | 1000~26000       | -64.36       | ≤-47        | 0.000366438 | ≤20        | PASS    |
|               | 11AC80SISO | Ant1    | 5210           | 30~1000          | -87.91       | ≤-54        | 0.000001618 | ≤4         | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity





|  |            |      |      |            |        |      |             |     |      |
|--|------------|------|------|------------|--------|------|-------------|-----|------|
|  | 11AX20SISO | Ant1 | 5180 | 1000~26000 | -63.29 | ≤-47 | 0.000468813 | ≤20 | PASS |
|  |            |      |      | 30~1000    | -88.35 | ≤-54 | 0.000001462 | ≤4  | PASS |
|  |            |      | 5200 | 1000~26000 | -63.47 | ≤-47 | 0.000449780 | ≤20 | PASS |
|  |            |      |      | 30~1000    | -88.42 | ≤-54 | 0.000001439 | ≤4  | PASS |
|  |            |      | 5240 | 1000~26000 | -63.37 | ≤-47 | 0.000460257 | ≤20 | PASS |
|  |            |      |      | 30~1000    | -88.17 | ≤-54 | 0.000001524 | ≤4  | PASS |
|  | 11AX40SISO | Ant1 | 5190 | 30~1000    | -88.62 | ≤-54 | 0.000001374 | ≤4  | PASS |
|  |            |      |      | 1000~26000 | -64.26 | ≤-47 | 0.000374973 | ≤20 | PASS |
|  |            |      | 5230 | 30~1000    | -87.99 | ≤-54 | 0.000001589 | ≤4  | PASS |
|  |            |      |      | 1000~26000 | -64.36 | ≤-47 | 0.000366438 | ≤20 | PASS |
|  | 11AX80SISO | Ant1 | 5210 | 30~1000    | -87.89 | ≤-54 | 0.000001626 | ≤4  | PASS |
|  |            |      |      | 1000~26000 | -63.53 | ≤-47 | 0.000443609 | ≤20 | PASS |



Remark: only recorded the plots of worst data(NTNV) in the report.


## Test Graphs

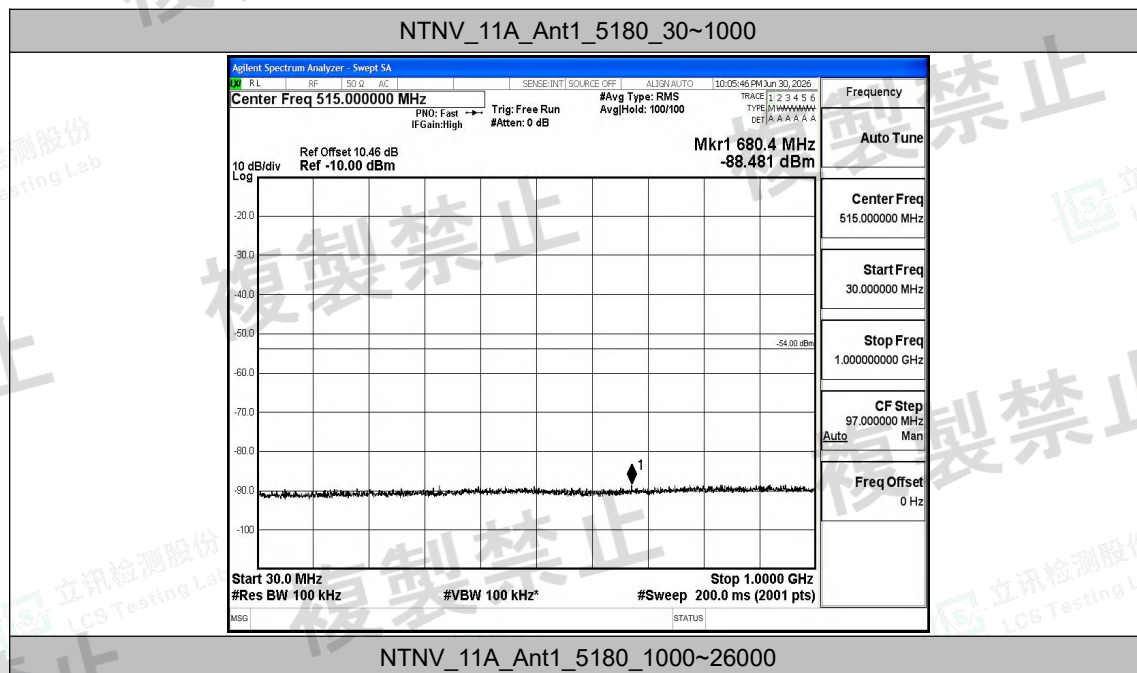



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

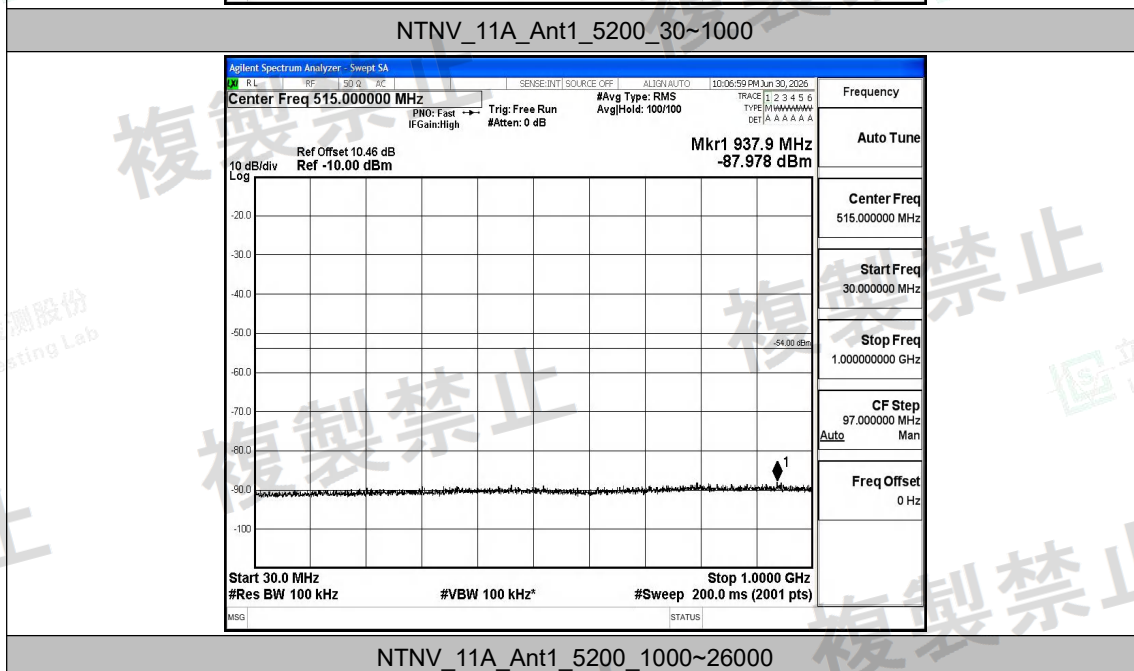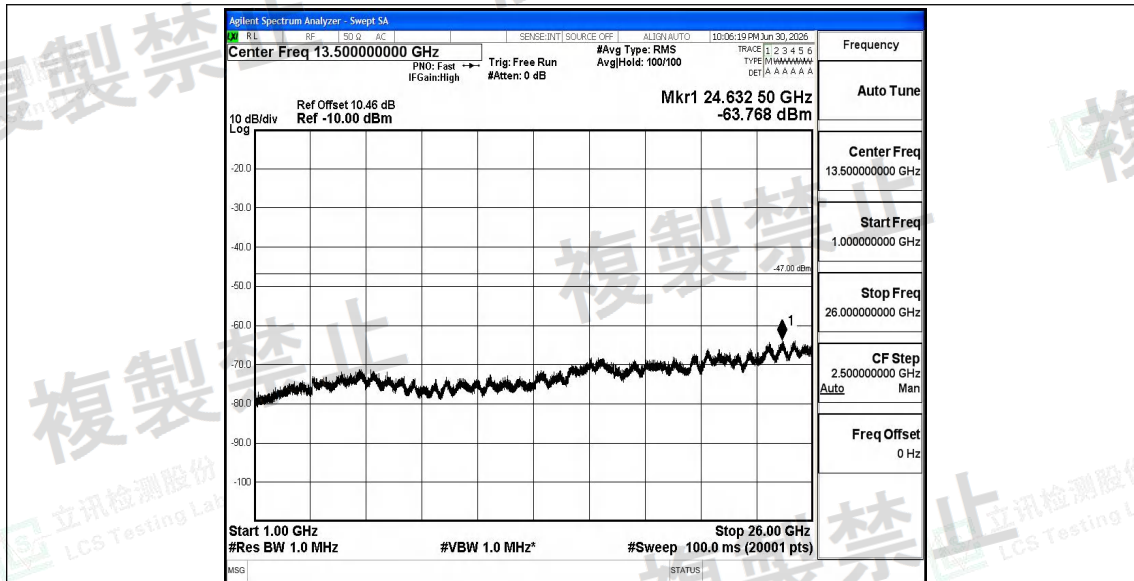


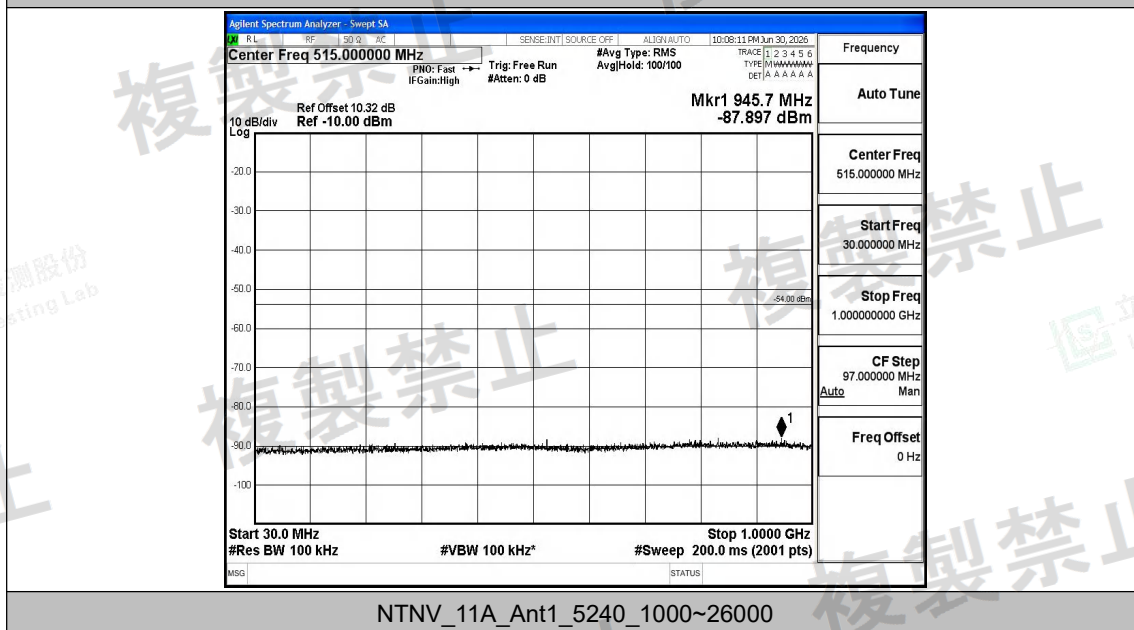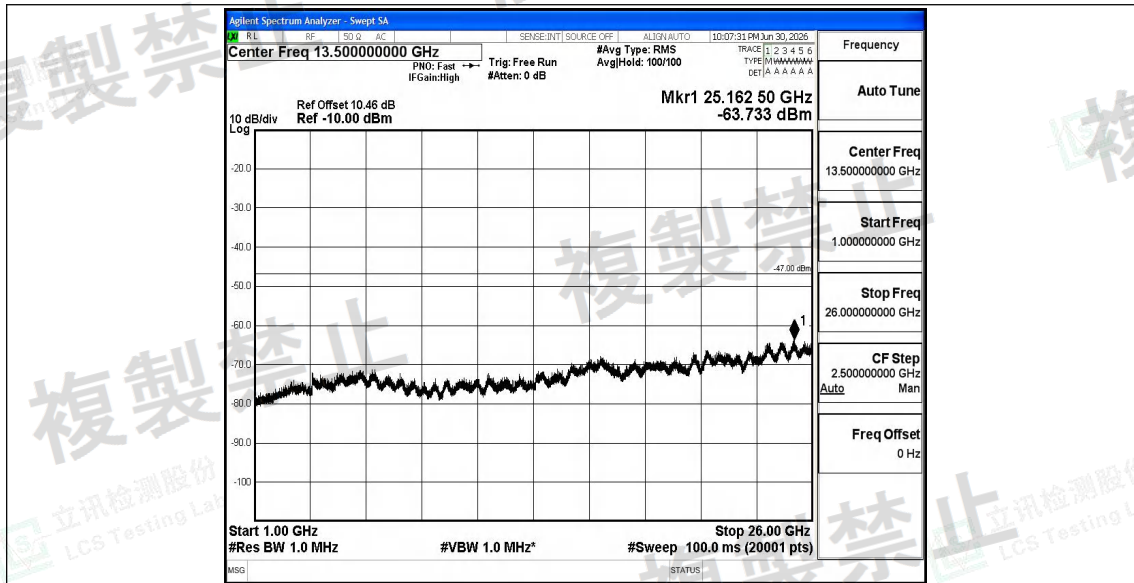


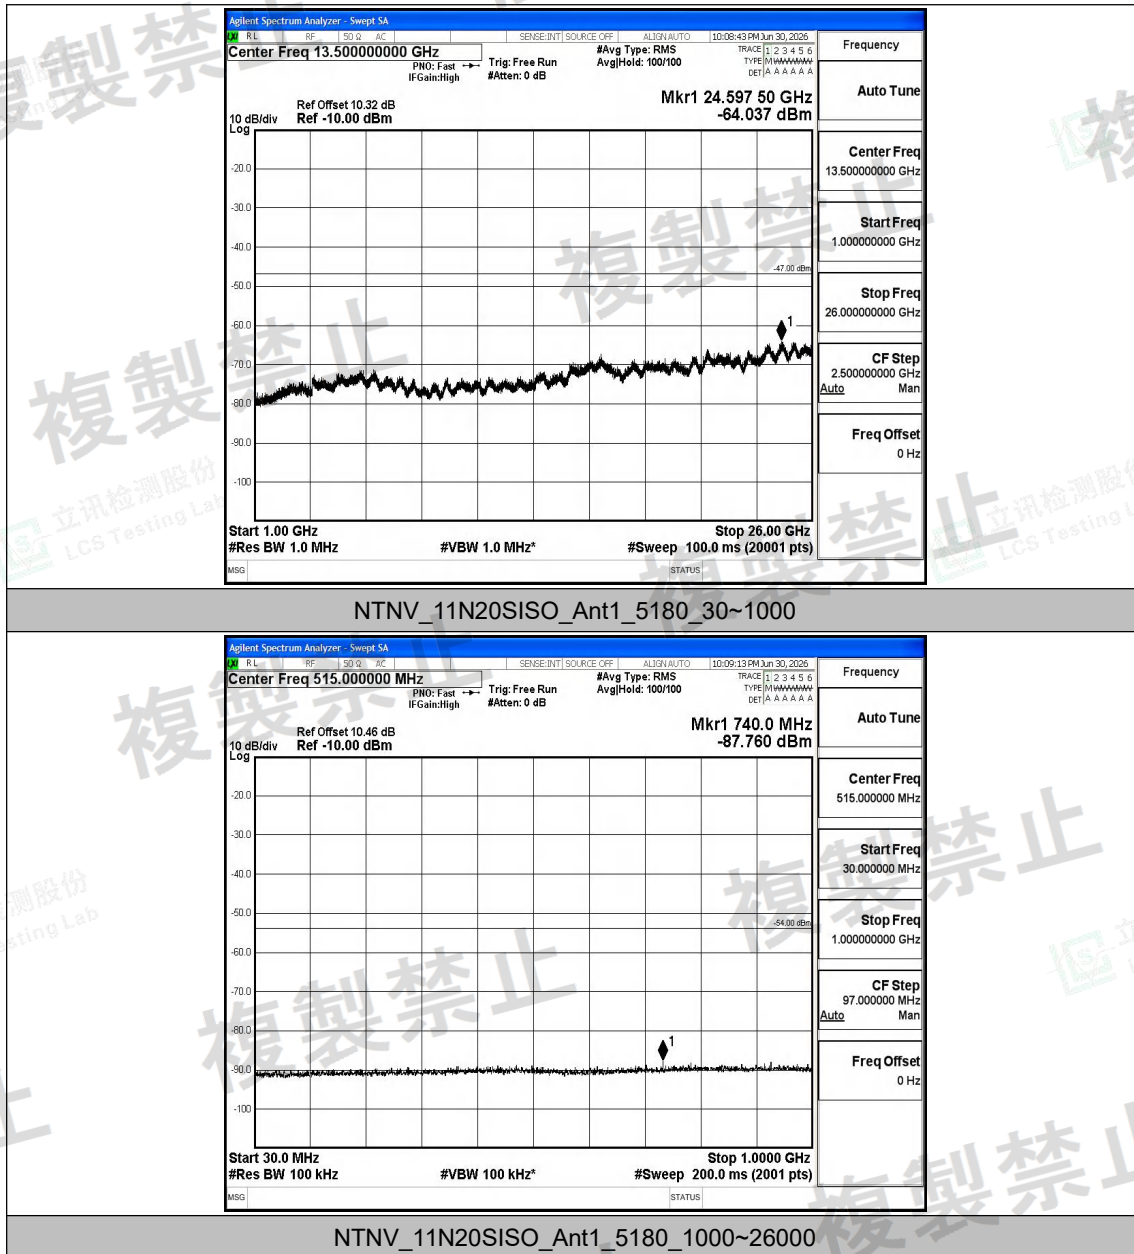

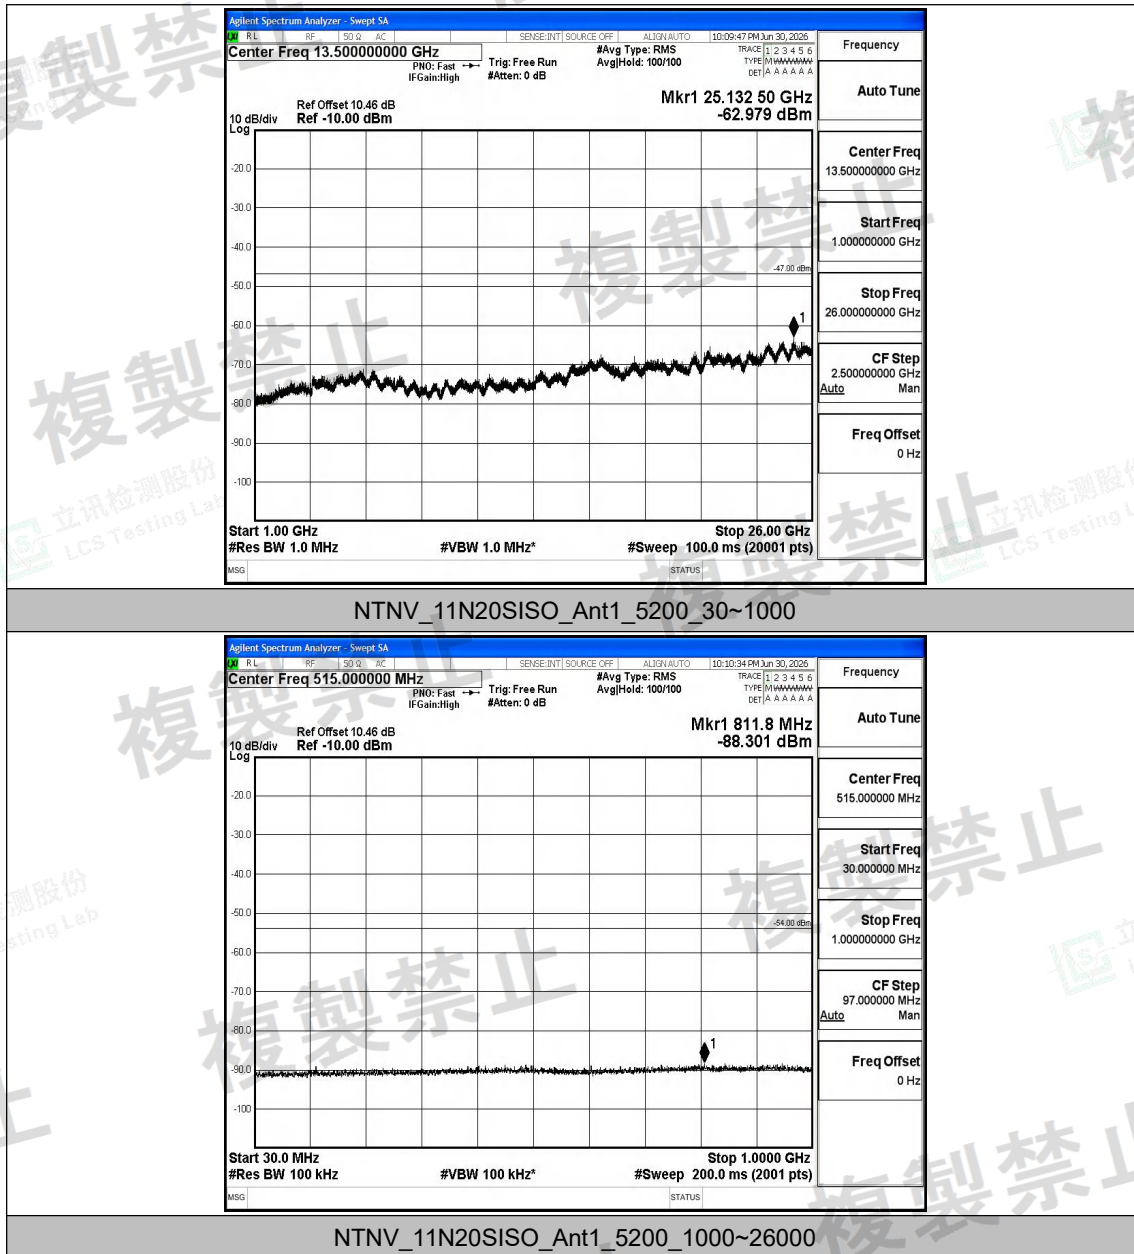


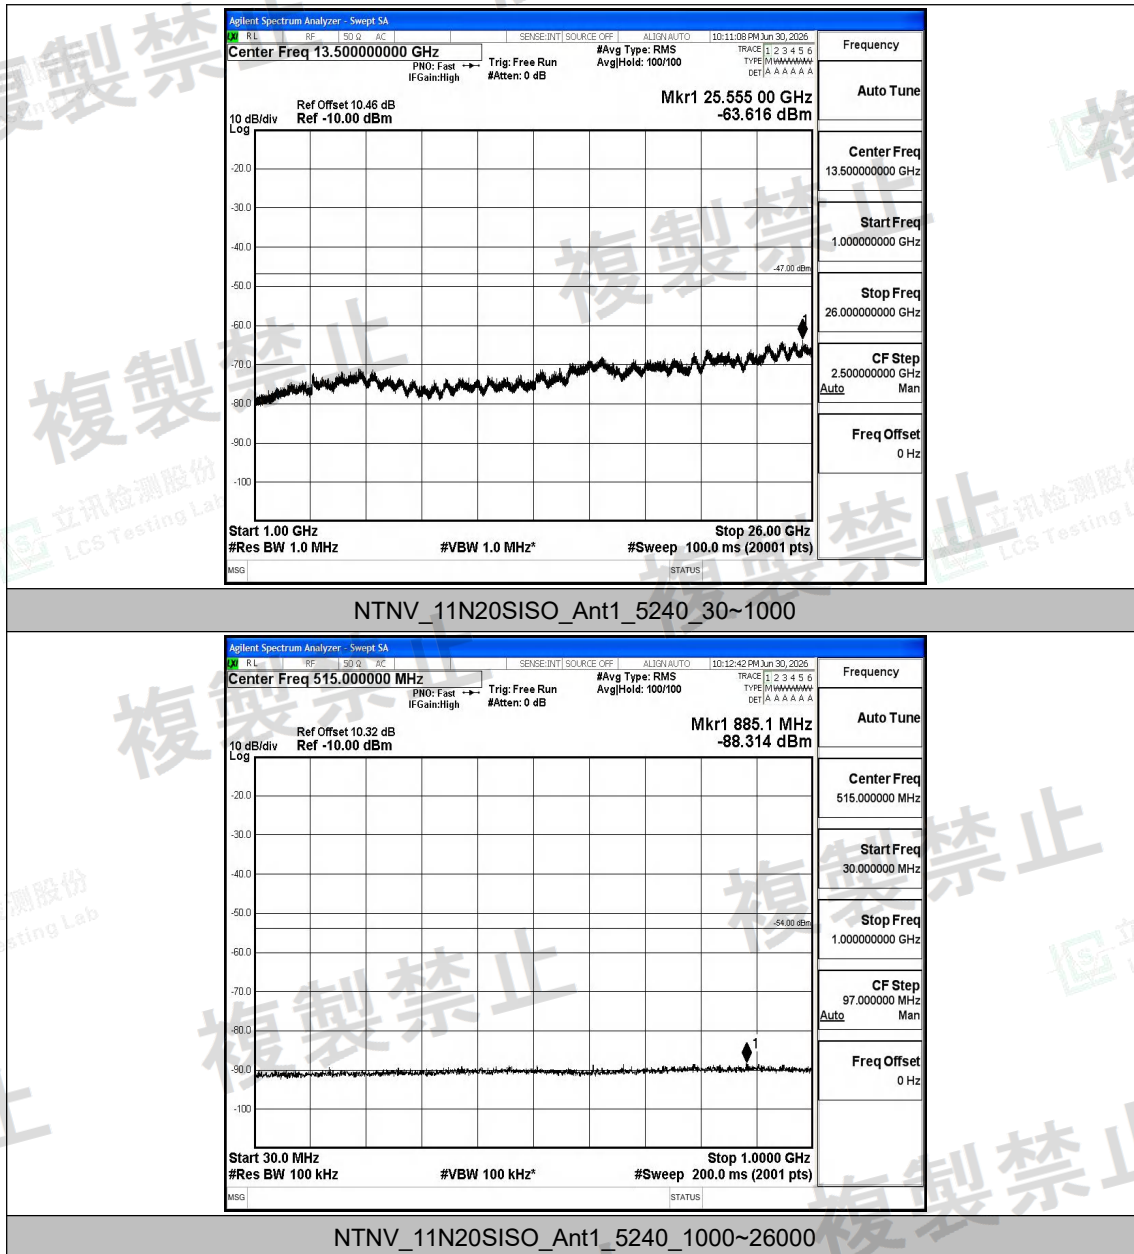

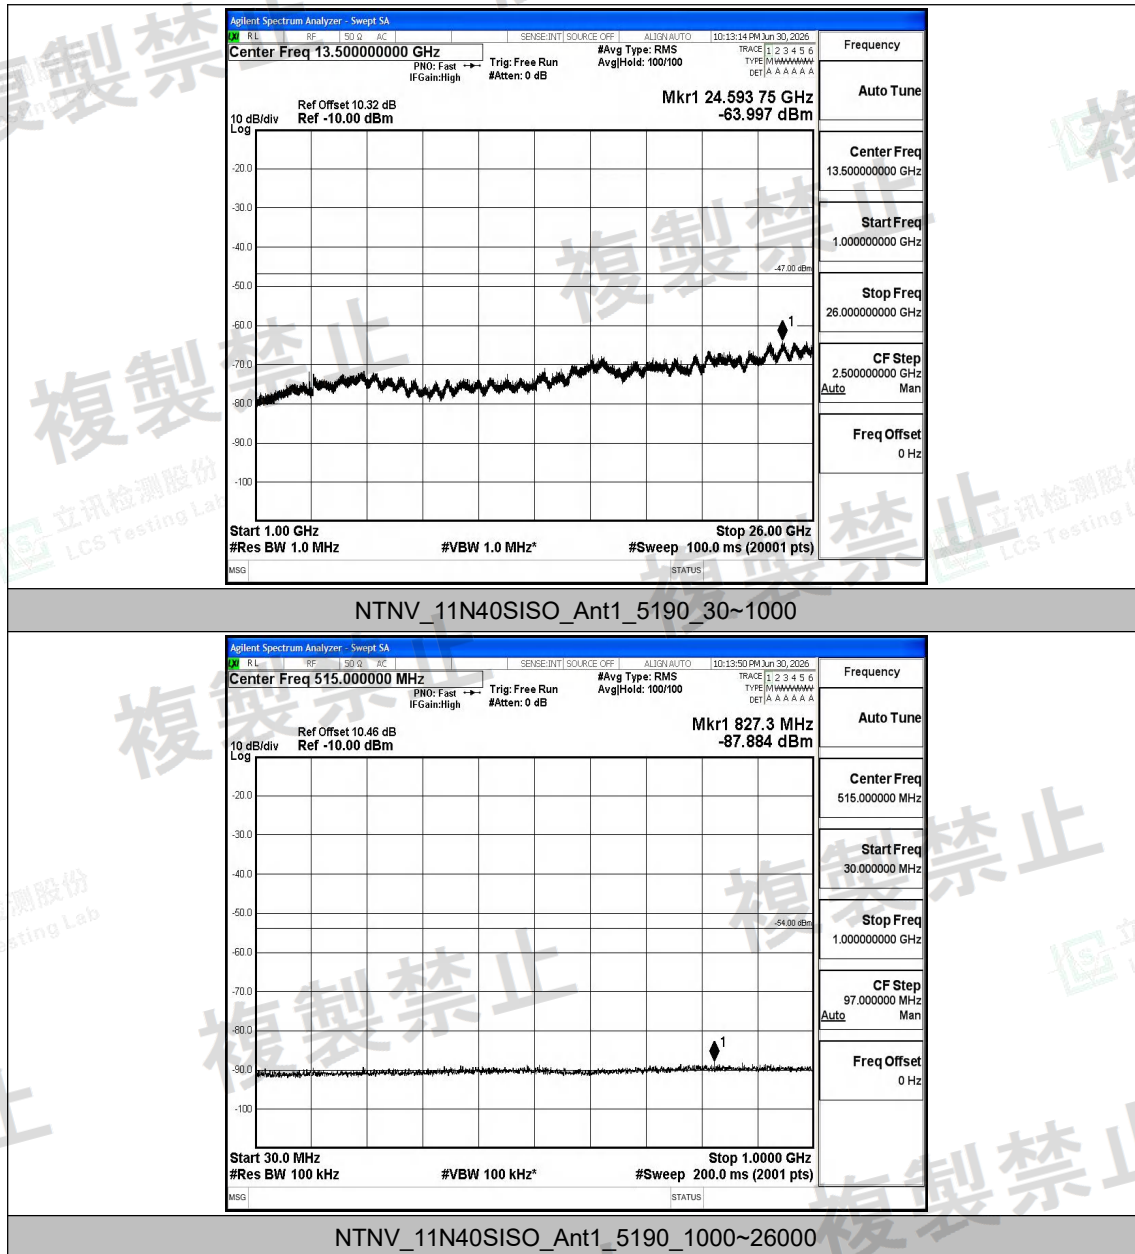


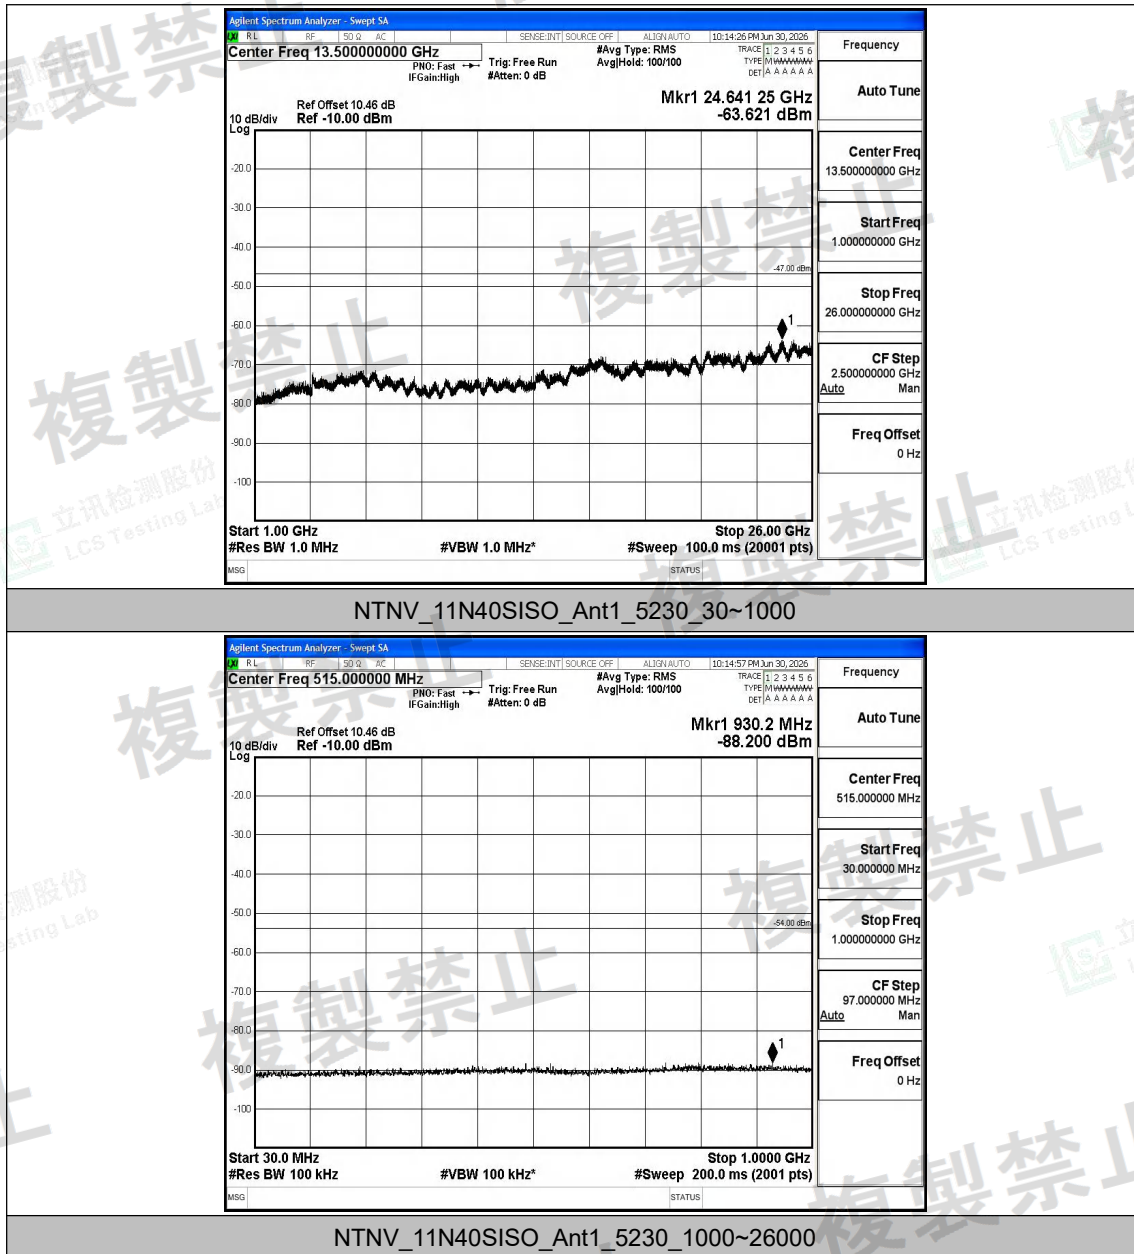

Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

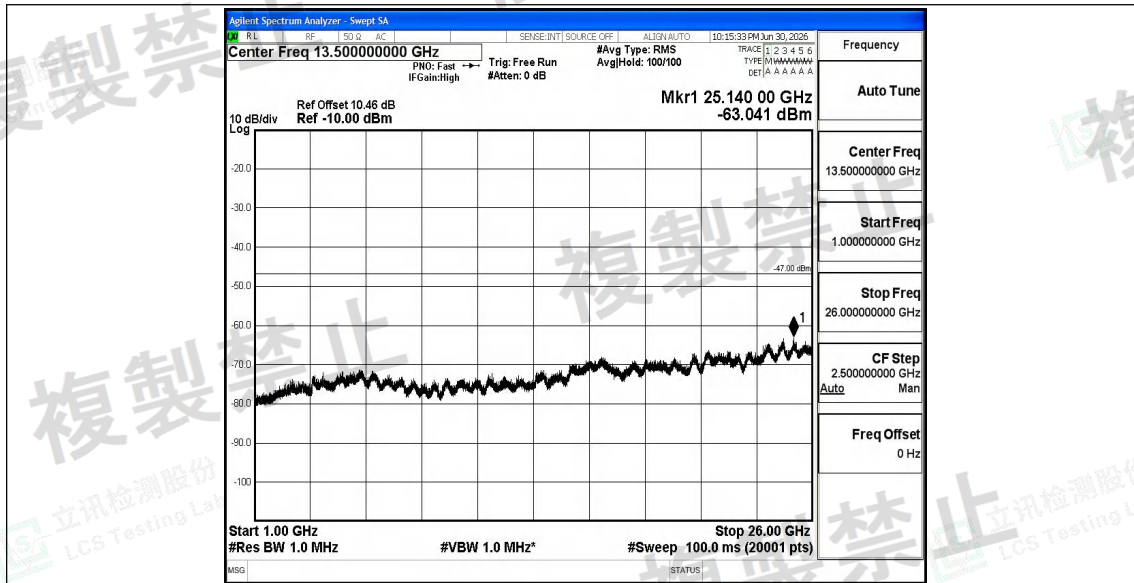


NTNV\_11AC20SISO\_Ant1\_5180\_30~1000

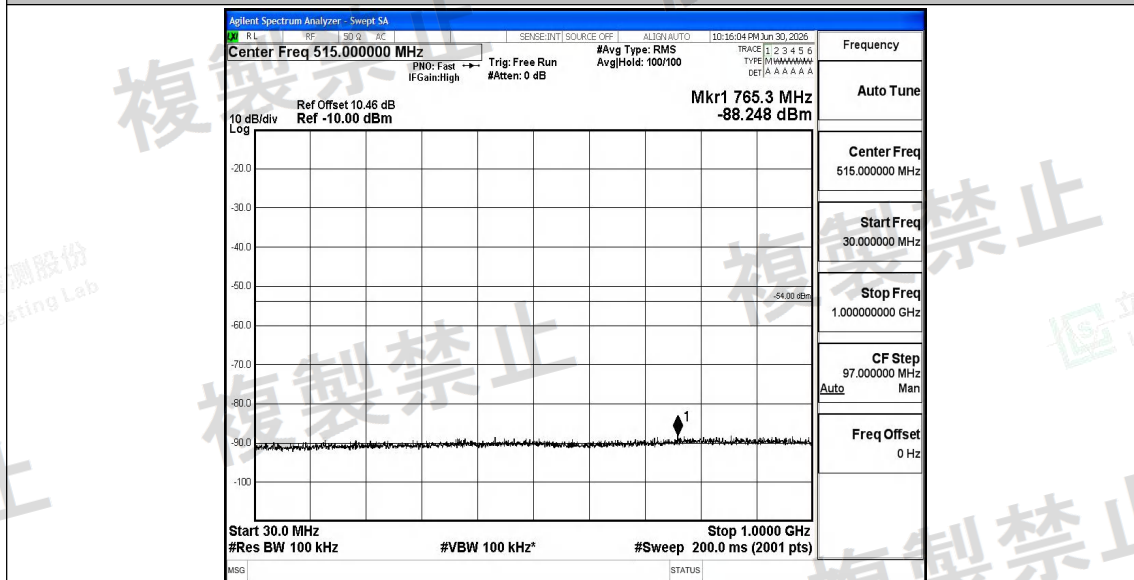


NTNV\_11AC20SISO\_Ant1\_5180\_1000~26000



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

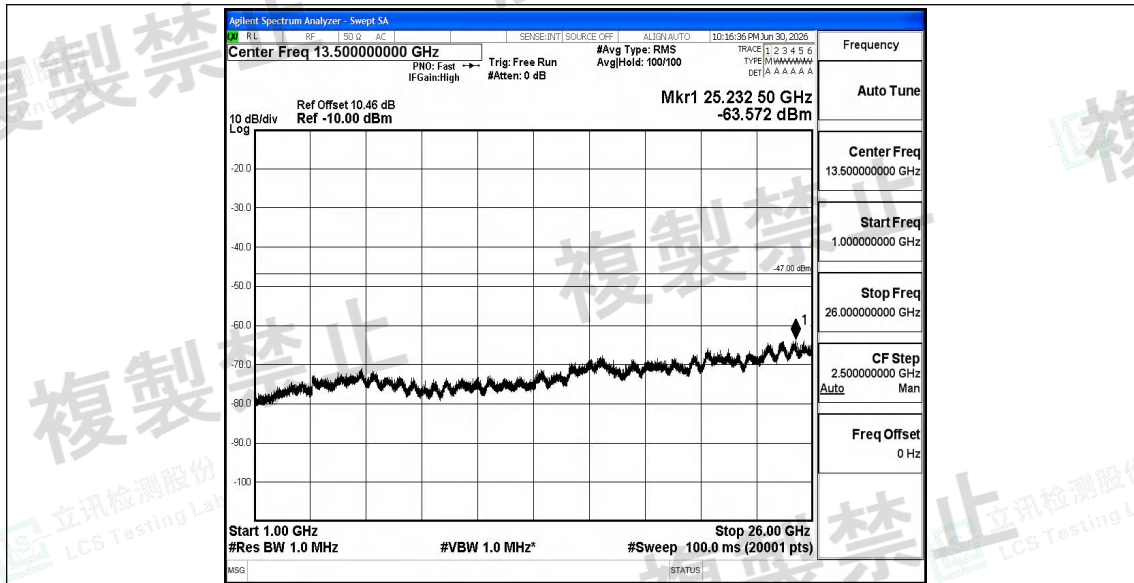


NTNV\_11AC20SISO\_Ant1\_5200\_30~1000

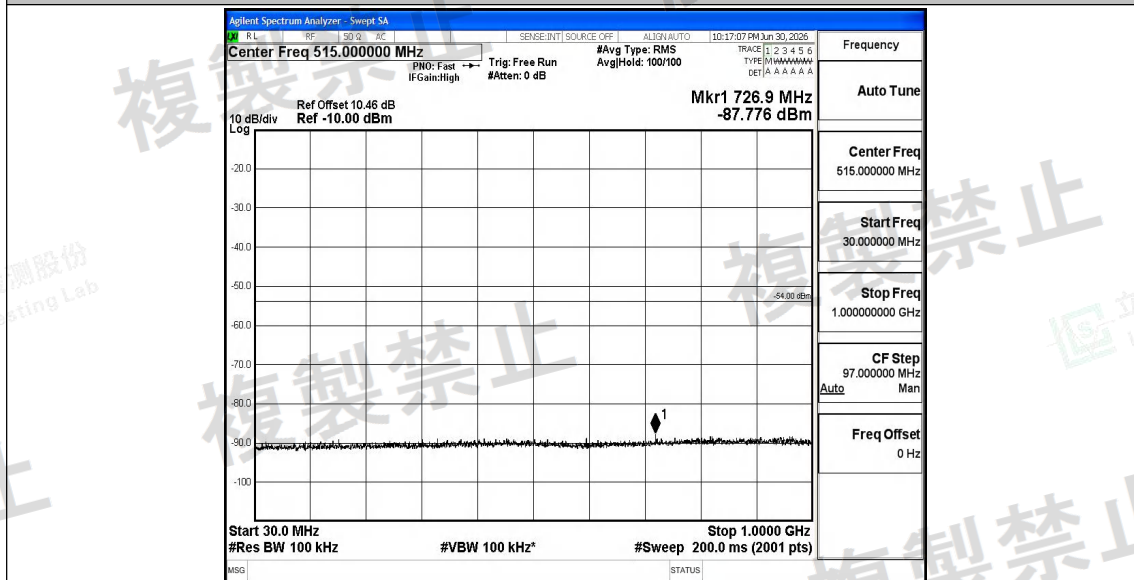


NTNV\_11AC20SISO\_Ant1\_5200\_1000~26000



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

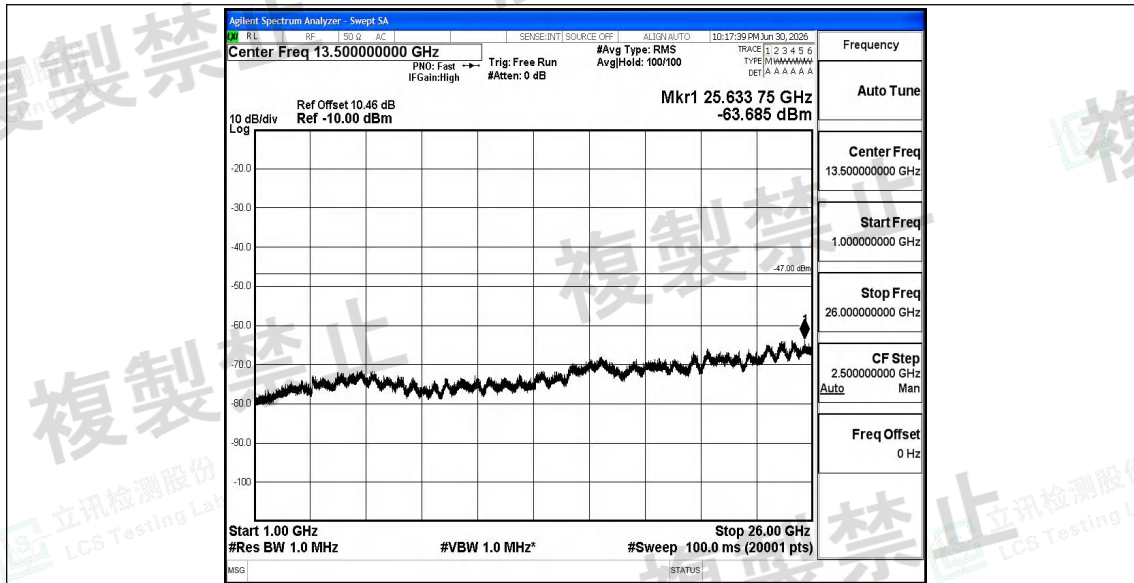


NTNV\_11AC20SISO\_Ant1\_5240\_30~1000

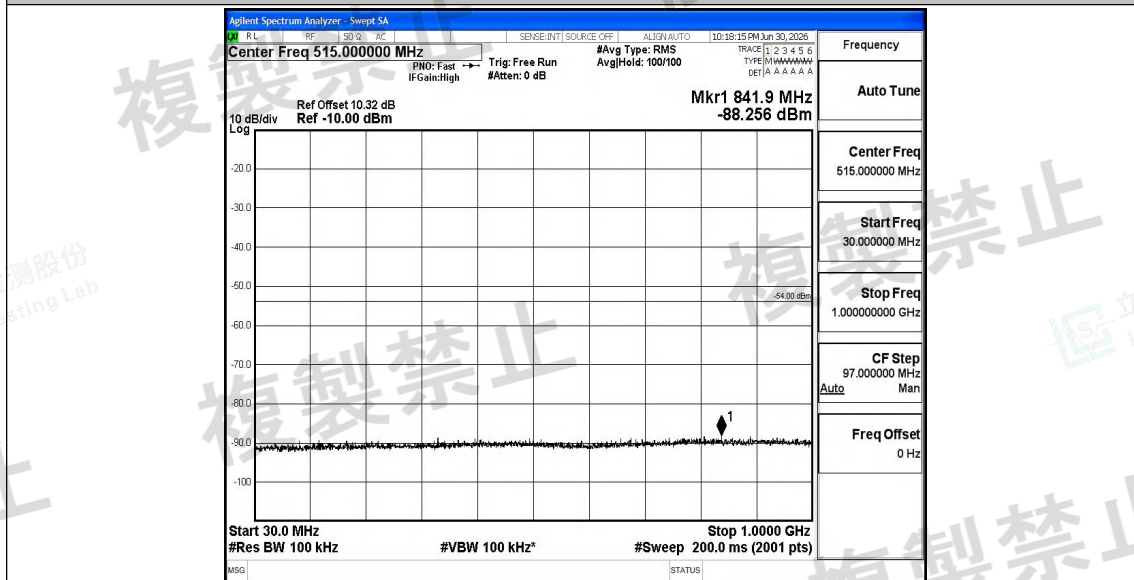


NTNV\_11AC20SISO\_Ant1\_5240\_1000~26000



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

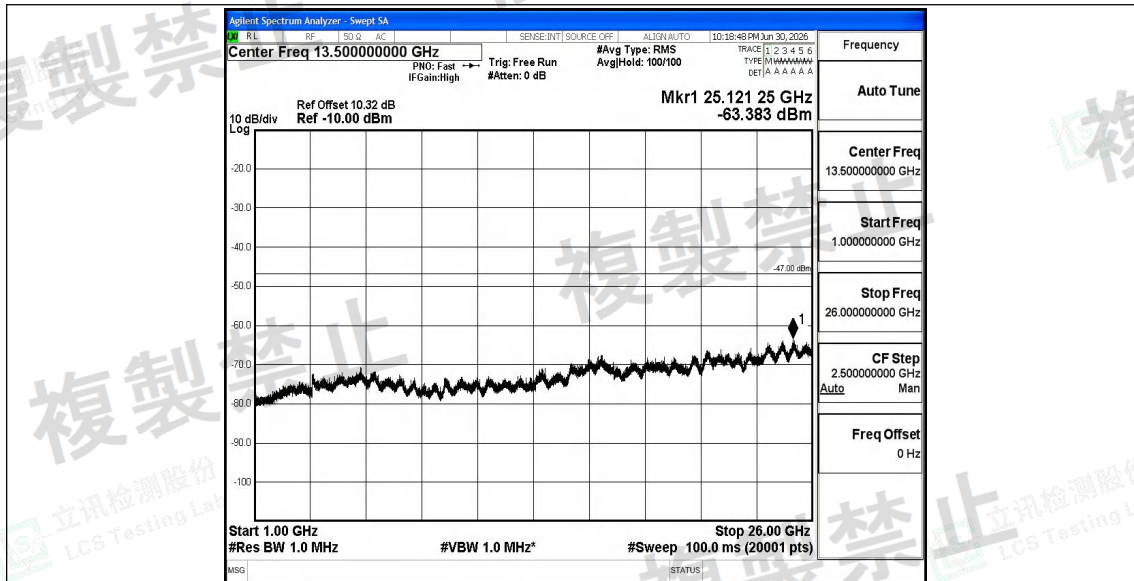


NTNV\_11AC40SISO\_Ant1\_5190\_30~1000

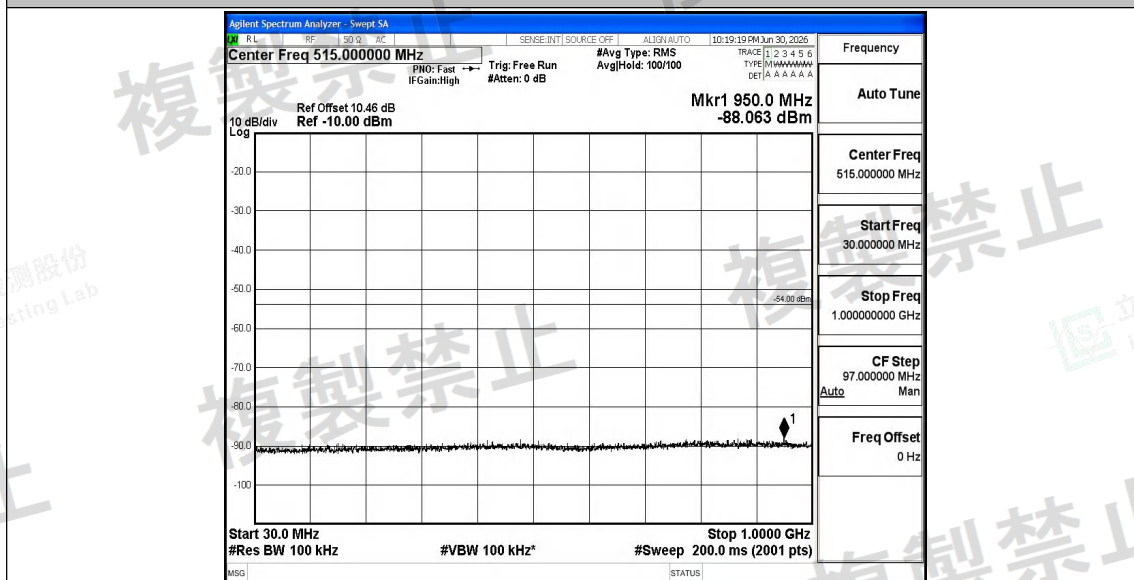


NTNV\_11AC40SISO\_Ant1\_5190\_1000~26000



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

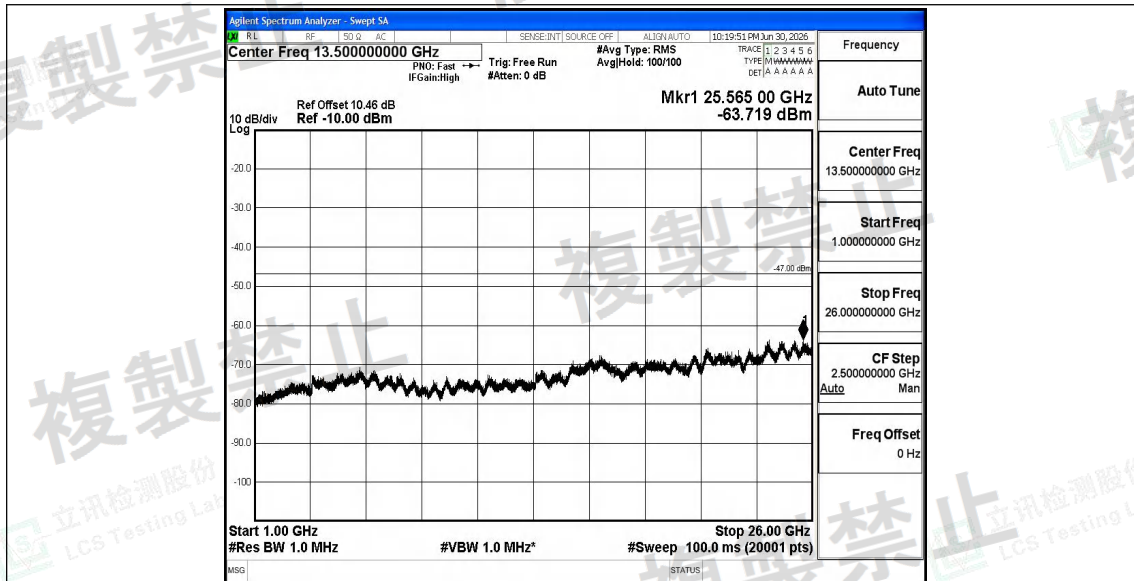


NTNV\_11AC40SISO\_Ant1\_5230\_30~1000

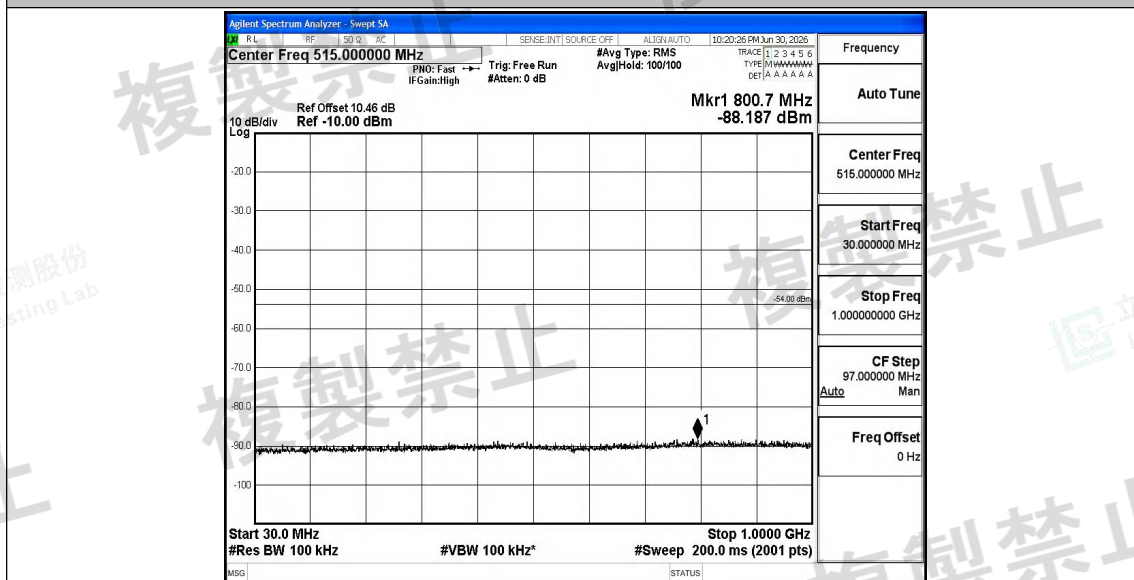


NTNV\_11AC40SISO\_Ant1\_5230\_1000~26000




Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

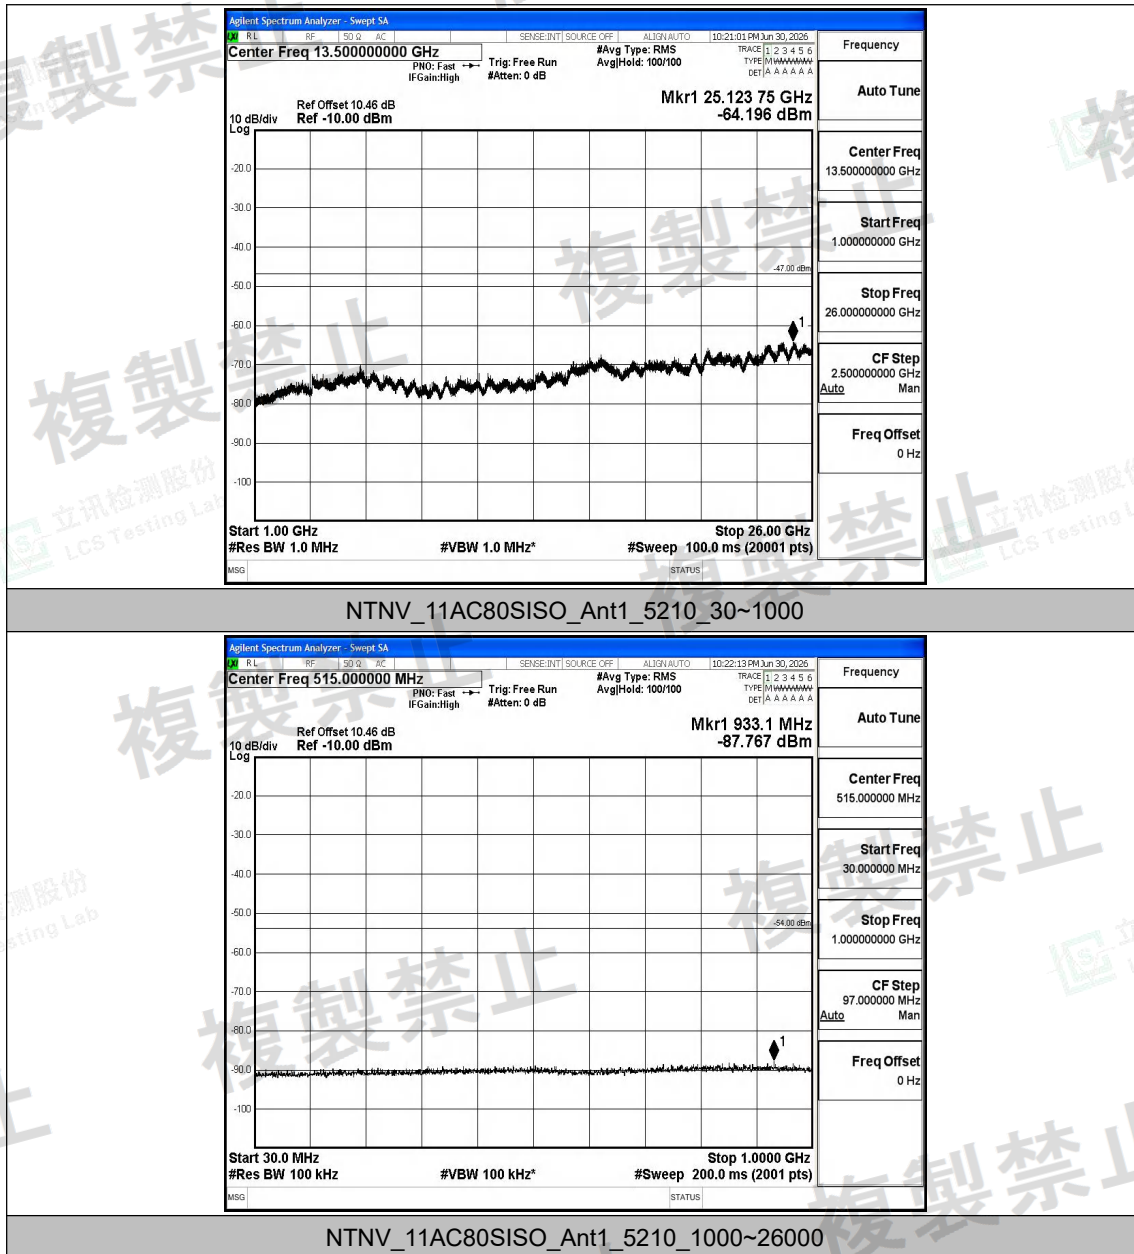

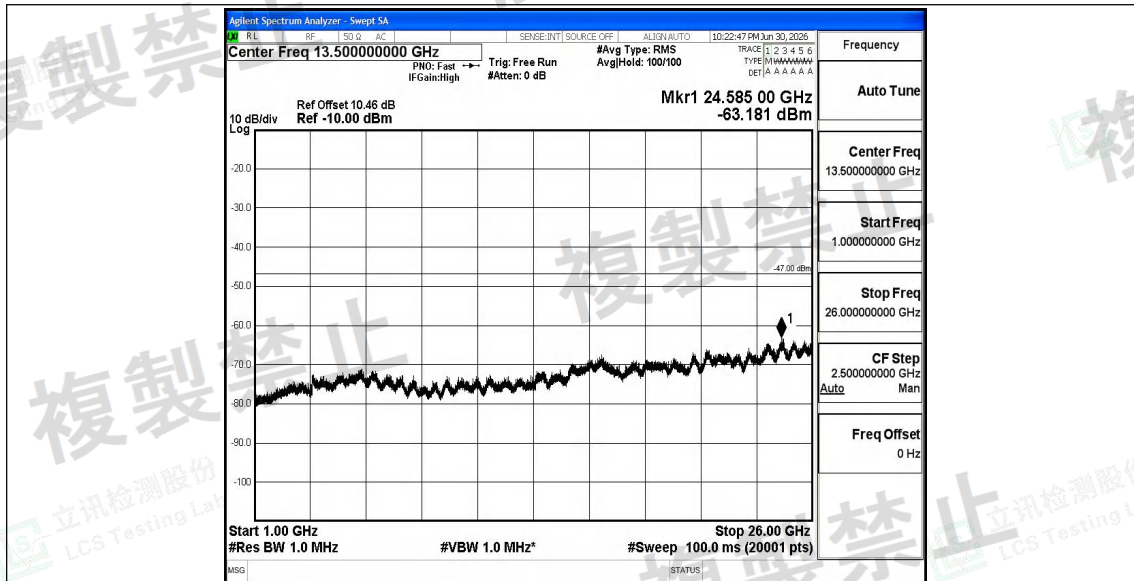


NTNV\_11AX20SISO\_Ant1\_5180\_30~1000

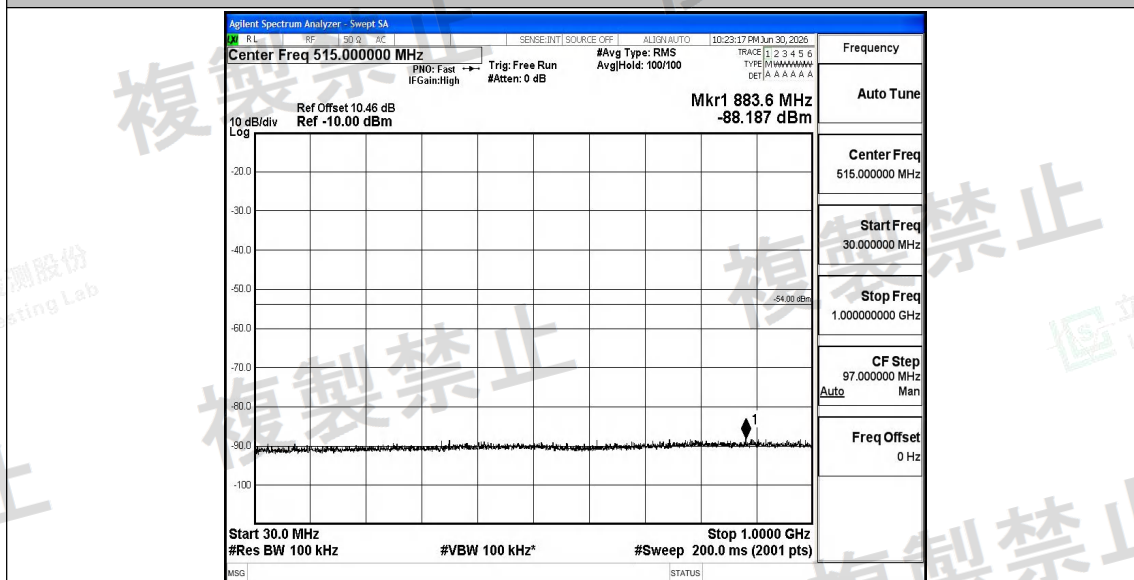


NTNV\_11AX20SISO\_Ant1\_5180\_1000~26000



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

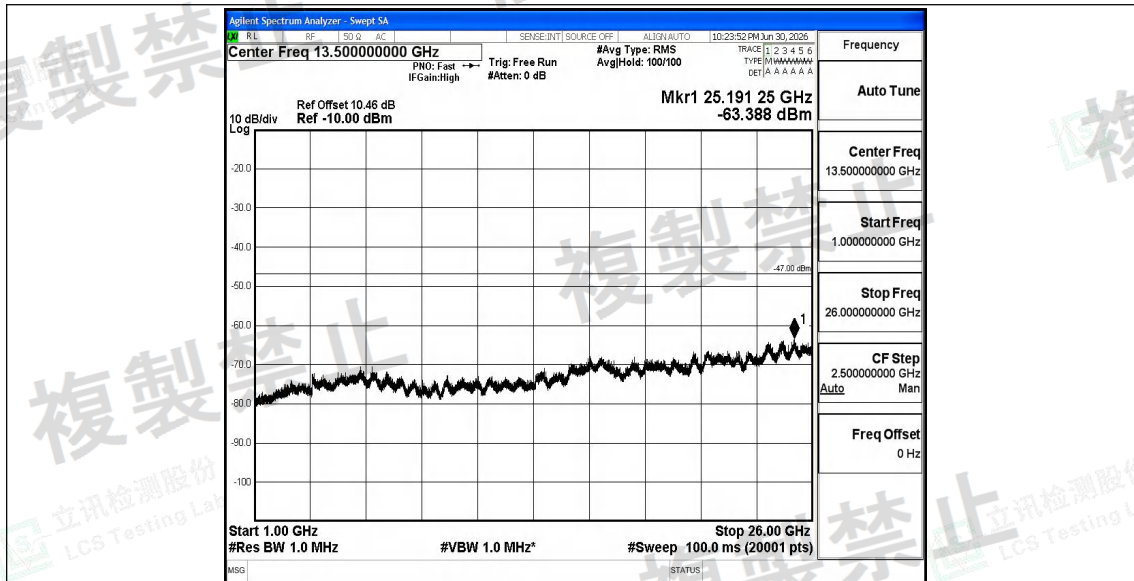


NTNV\_11AX20SISO\_Ant1\_5200\_30~1000

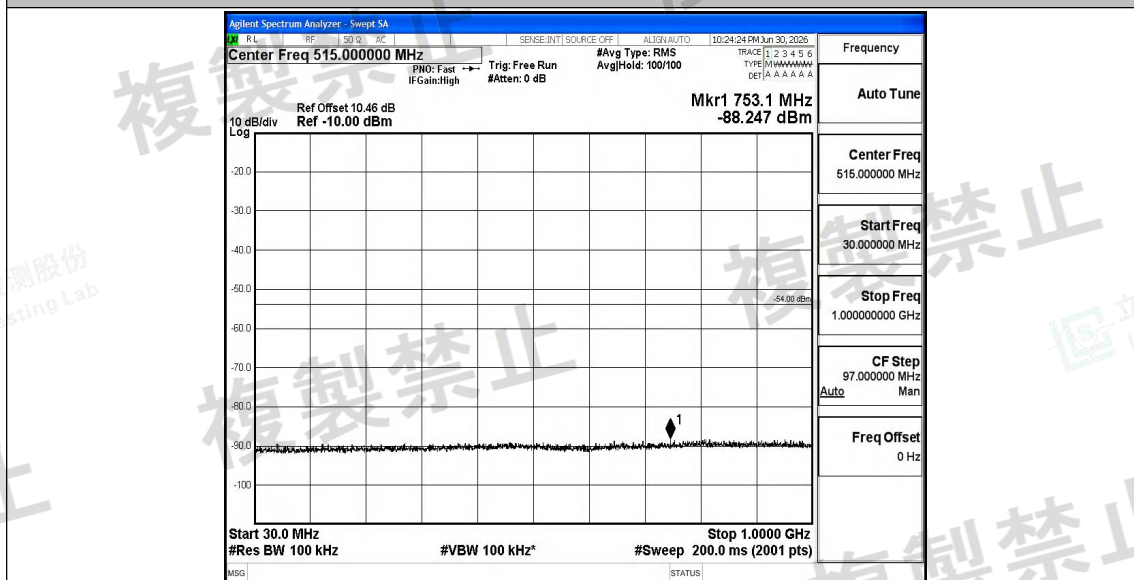


NTNV\_11AX20SISO\_Ant1\_5200\_1000~26000



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

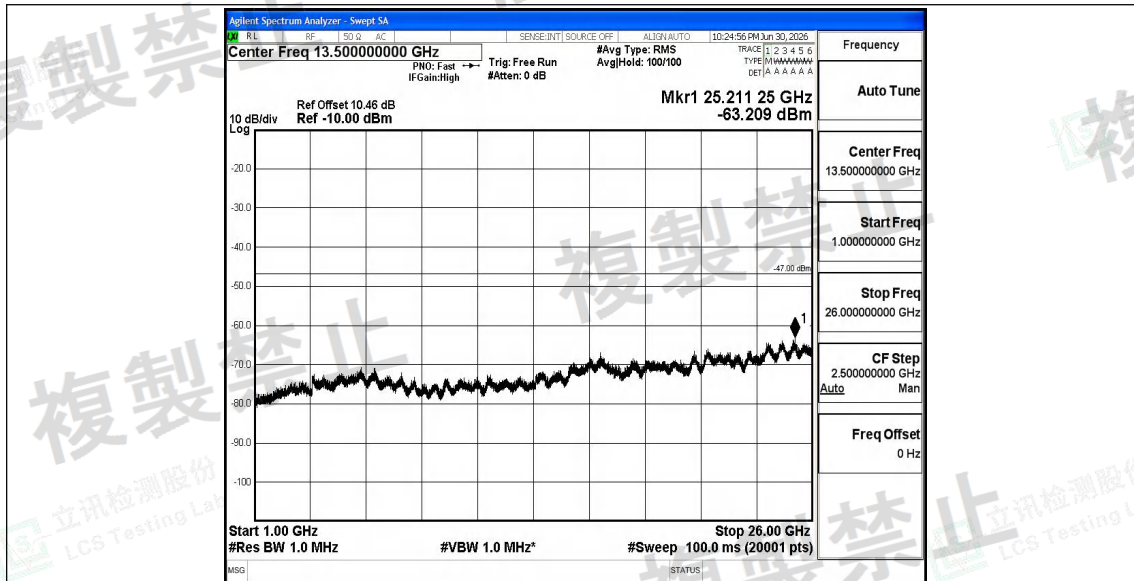


NTNV\_11AX20SISO\_Ant1\_5240\_30~1000

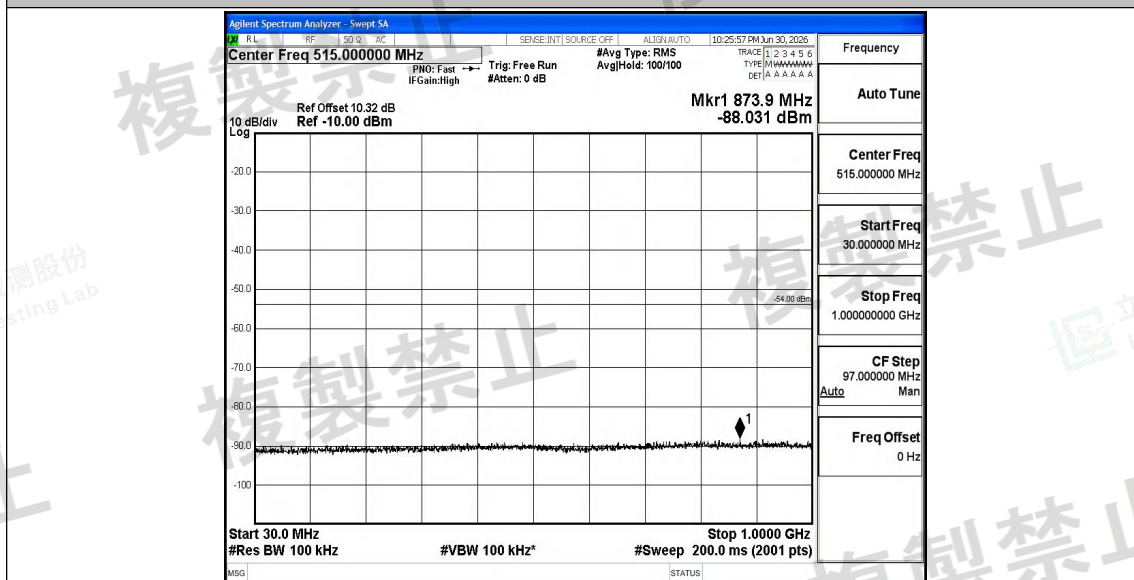


NTNV\_11AX20SISO\_Ant1\_5240\_1000~26000



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

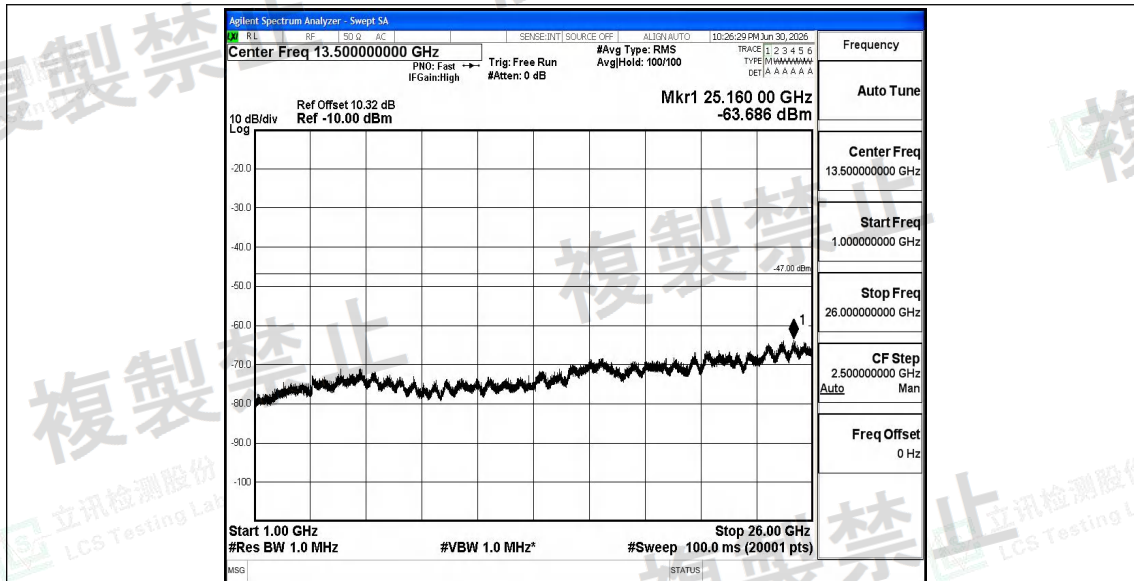


NTNV\_11AX40SISO\_Ant1\_5190\_30~1000

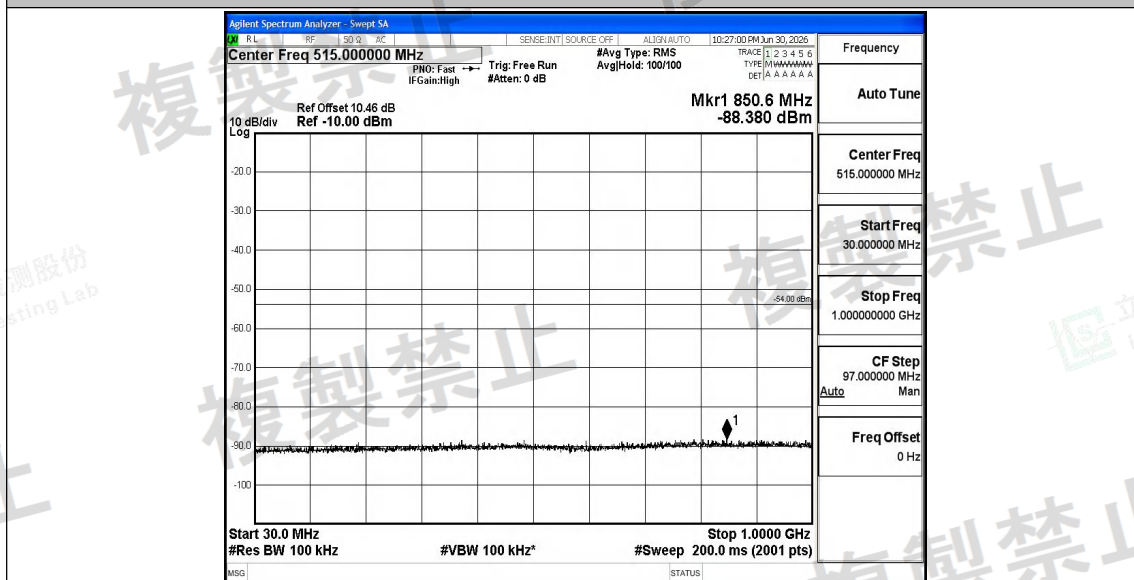


NTNV\_11AX40SISO\_Ant1\_5190\_1000~26000



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

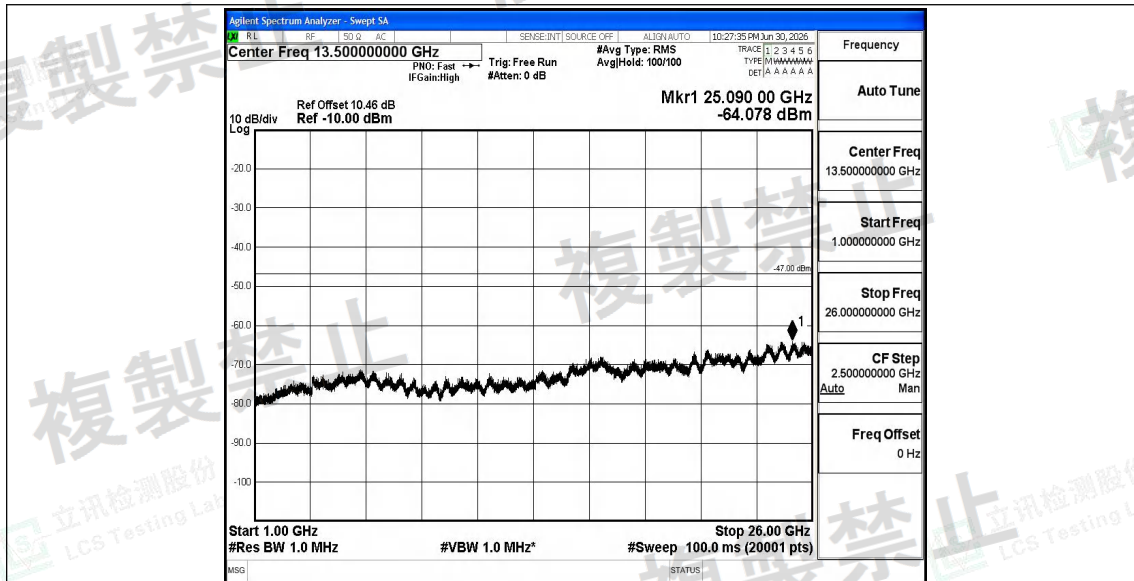


NTNV\_11AX40SISO\_Ant1\_5230\_30~1000

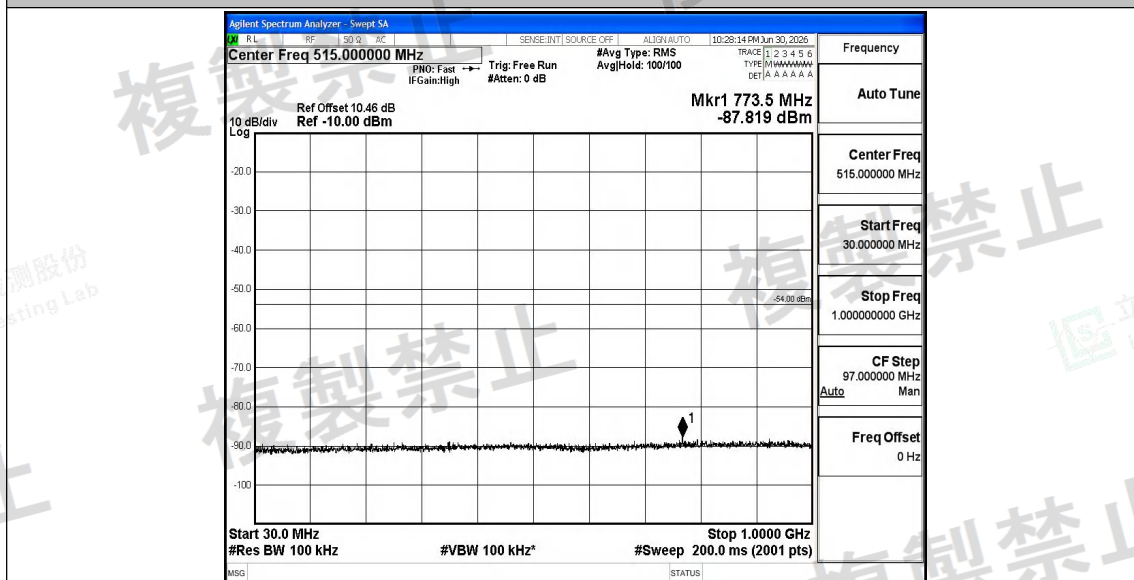


NTNV\_11AX40SISO\_Ant1\_5230\_1000~26000



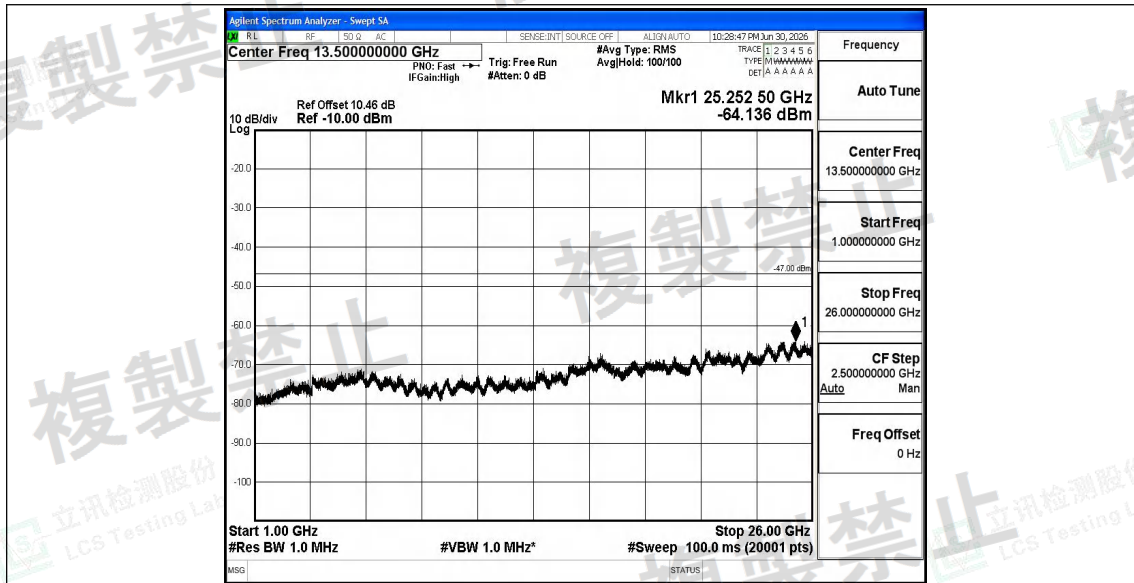


NTNV\_11AX80SISO\_Ant1\_5210\_30~1000

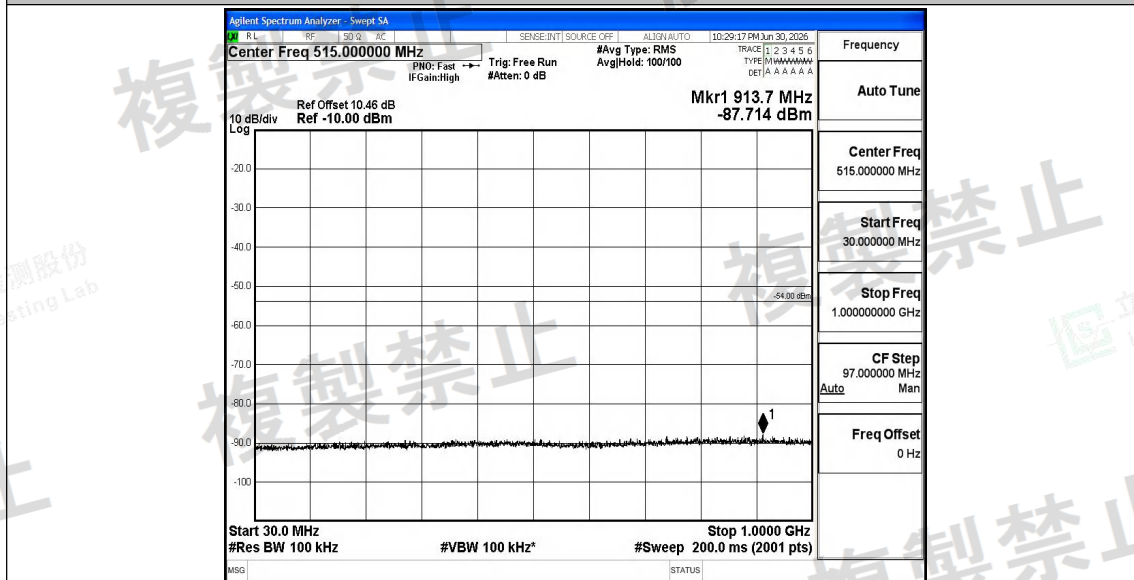

NTNV\_11AX80SISO\_Ant1\_5210\_1000~26000



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

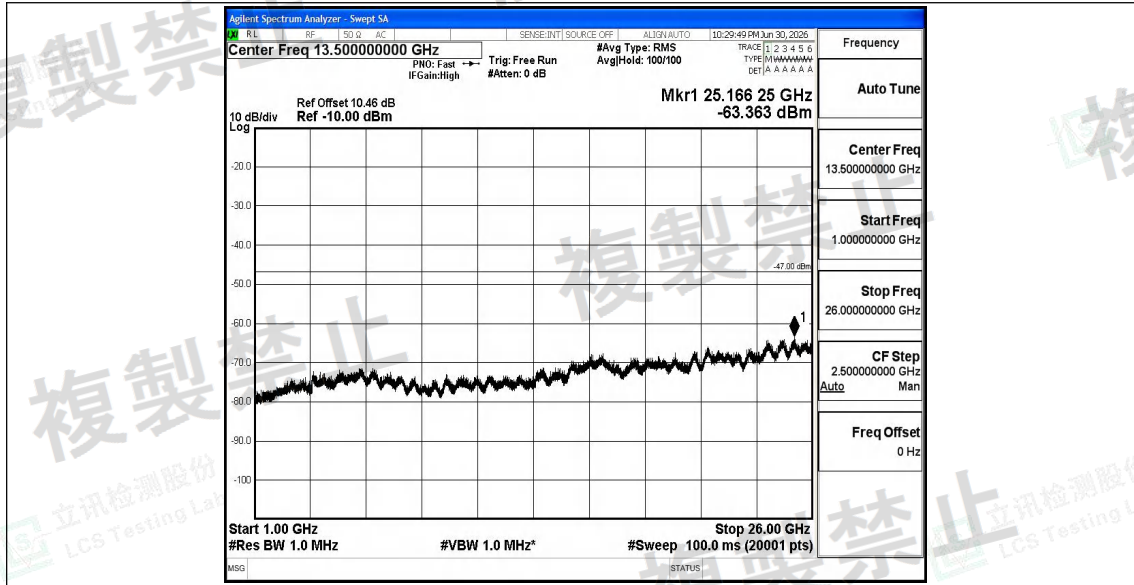

Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



## B.7 Transmission Burst Length

### Test Result

| TestCondition | TestMode   | Antenna | Frequency[MHz] | Result [ms] | Limit [ms] | Verdict |
|---------------|------------|---------|----------------|-------------|------------|---------|
| NTNV          | 11A        | Ant1    | 5180           | 1.39        | ≤8         | PASS    |
|               |            |         | 5200           | 1.39        | ≤8         | PASS    |
|               |            |         | 5240           | 1.39        | ≤8         | PASS    |
|               | 11N20SISO  | Ant1    | 5180           | 1.18        | ≤8         | PASS    |
|               |            |         | 5200           | 1.18        | ≤8         | PASS    |
|               |            |         | 5240           | 1.18        | ≤8         | PASS    |
|               | 11N40SISO  | Ant1    | 5190           | 0.58        | ≤8         | PASS    |
|               |            |         | 5230           | 0.58        | ≤8         | PASS    |
|               | 11AC20SISO | Ant1    | 5180           | 1.19        | ≤8         | PASS    |
|               |            |         | 5200           | 1.19        | ≤8         | PASS    |
|               |            |         | 5240           | 1.19        | ≤8         | PASS    |
|               | 11AC40SISO | Ant1    | 5190           | 0.59        | ≤8         | PASS    |
|               |            |         | 5230           | 0.59        | ≤8         | PASS    |
|               | 11AC80SISO | Ant1    | 5210           | 0.29        | ≤8         | PASS    |
|               | 11AX20SISO | Ant1    | 5180           | 1.19        | ≤8         | PASS    |
|               |            |         | 5200           | 1.19        | ≤8         | PASS    |
|               |            |         | 5240           | 1.19        | ≤8         | PASS    |
|               | 11AX40SISO | Ant1    | 5190           | 0.59        | ≤8         | PASS    |
|               |            |         | 5230           | 0.59        | ≤8         | PASS    |
|               | 11AX80SISO | Ant1    | 5210           | 0.29        | ≤8         | PASS    |

| TestCondition | TestMode   | Antenna | Frequency[MHz] | Result [ms] | Limit [ms] | Verdict |
|---------------|------------|---------|----------------|-------------|------------|---------|
| NTHV          | 11A        | Ant1    | 5180           | 1.35        | ≤8         | PASS    |
|               |            |         | 5200           | 1.33        | ≤8         | PASS    |
|               |            |         | 5240           | 1.35        | ≤8         | PASS    |
|               | 11N20SISO  | Ant1    | 5180           | 1.15        | ≤8         | PASS    |
|               |            |         | 5200           | 1.13        | ≤8         | PASS    |
|               |            |         | 5240           | 1.12        | ≤8         | PASS    |
|               | 11N40SISO  | Ant1    | 5190           | 0.55        | ≤8         | PASS    |
|               |            |         | 5230           | 0.53        | ≤8         | PASS    |
|               | 11AC20SISO | Ant1    | 5180           | 1.16        | ≤8         | PASS    |
|               |            |         | 5200           | 1.16        | ≤8         | PASS    |
|               |            |         | 5240           | 1.16        | ≤8         | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|  |            |      |      |      |    |      |
|--|------------|------|------|------|----|------|
|  | 11AC40SISO | Ant1 | 5190 | 0.56 | ≤8 | PASS |
|  |            |      | 5230 | 0.57 | ≤8 | PASS |
|  | 11AC80SISO | Ant1 | 5210 | 0.25 | ≤8 | PASS |
|  |            |      |      |      |    |      |
|  | 11AX20SISO | Ant1 | 5180 | 1.17 | ≤8 | PASS |
|  |            |      | 5200 | 1.17 | ≤8 | PASS |
|  |            |      | 5240 | 1.17 | ≤8 | PASS |
|  | 11AX40SISO | Ant1 | 5190 | 0.58 | ≤8 | PASS |
|  |            |      | 5230 | 0.58 | ≤8 | PASS |
|  | 11AX80SISO | Ant1 | 5210 | 0.28 | ≤8 | PASS |

| TestCondition | TestMode   | Antenna | Frequency[MHz] | Result [ms] | Limit [ms] | Verdict |
|---------------|------------|---------|----------------|-------------|------------|---------|
| NTLV          | 11A        | Ant1    | 5180           | 1.34        | ≤8         | PASS    |
|               |            |         | 5200           | 1.32        | ≤8         | PASS    |
|               |            |         | 5240           | 1.33        | ≤8         | PASS    |
|               | 11N20SISO  | Ant1    | 5180           | 1.14        | ≤8         | PASS    |
|               |            |         | 5200           | 1.12        | ≤8         | PASS    |
|               |            |         | 5240           | 1.12        | ≤8         | PASS    |
|               | 11N40SISO  | Ant1    | 5190           | 0.54        | ≤8         | PASS    |
|               |            |         | 5230           | 0.52        | ≤8         | PASS    |
|               | 11AC20SISO | Ant1    | 5180           | 1.15        | ≤8         | PASS    |
|               |            |         | 5200           | 1.15        | ≤8         | PASS    |
|               |            |         | 5240           | 1.15        | ≤8         | PASS    |
|               | 11AC40SISO | Ant1    | 5190           | 0.55        | ≤8         | PASS    |
|               |            |         | 5230           | 0.56        | ≤8         | PASS    |
|               | 11AC80SISO | Ant1    | 5210           | 0.25        | ≤8         | PASS    |
|               | 11AX20SISO | Ant1    | 5180           | 1.16        | ≤8         | PASS    |
|               |            |         | 5200           | 1.16        | ≤8         | PASS    |
|               |            |         | 5240           | 1.16        | ≤8         | PASS    |
|               | 11AX40SISO | Ant1    | 5190           | 0.58        | ≤8         | PASS    |
|               |            |         | 5230           | 0.58        | ≤8         | PASS    |
|               | 11AX80SISO | Ant1    | 5210           | 0.28        | ≤8         | PASS    |

Remark: only recorded the plots of worst data(NTNV) in the report.



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## NTNV 11A Ant1 5180



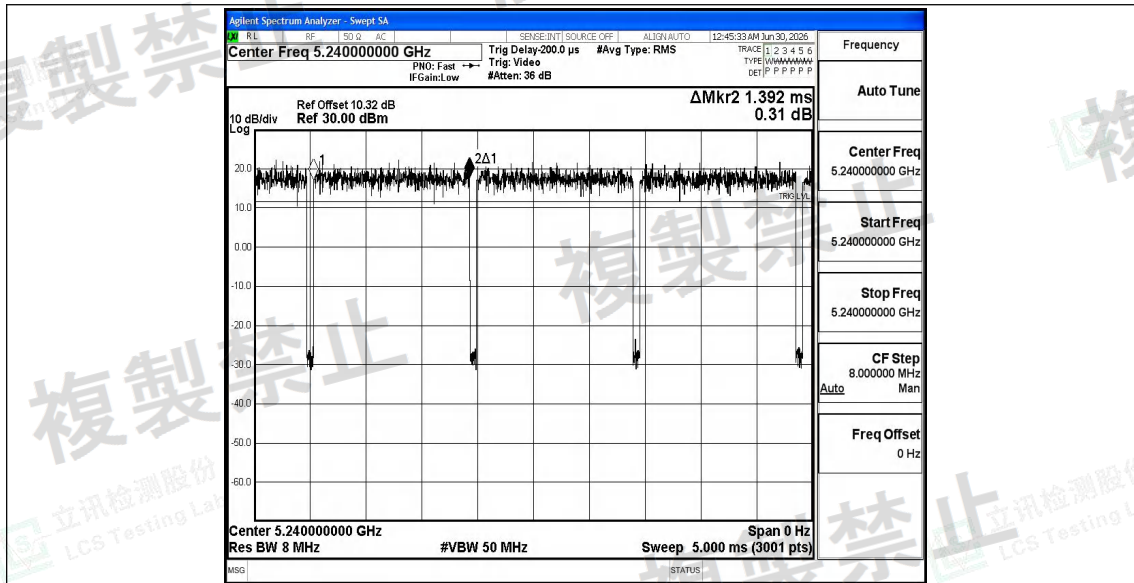



NTNV\_11N20SISO\_Ant1\_5180

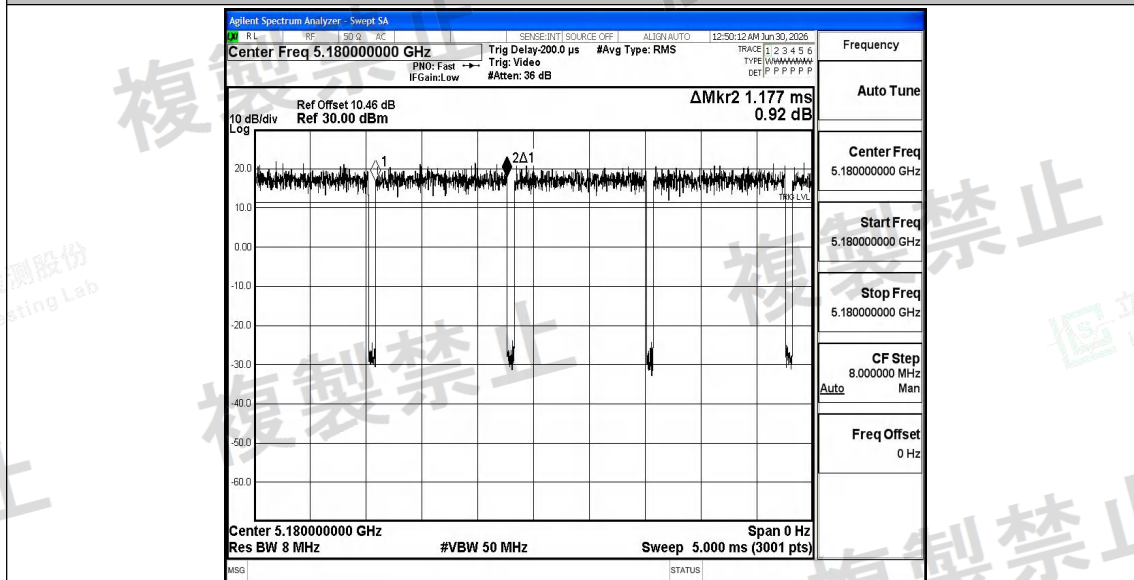


NTNV\_11N20SISO\_Ant1\_5200




Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

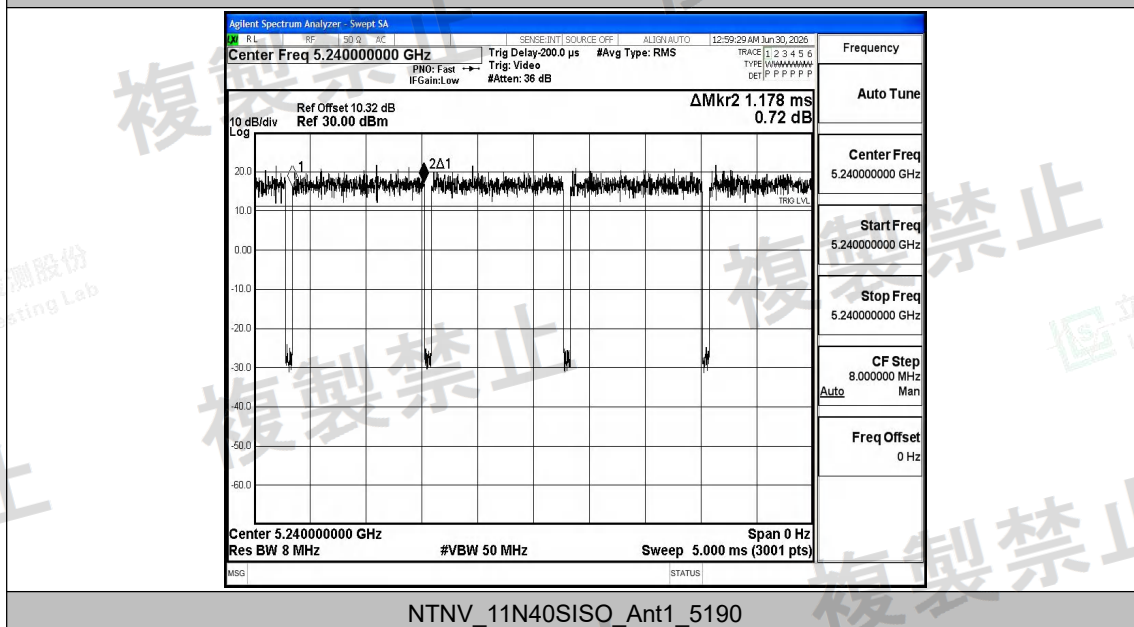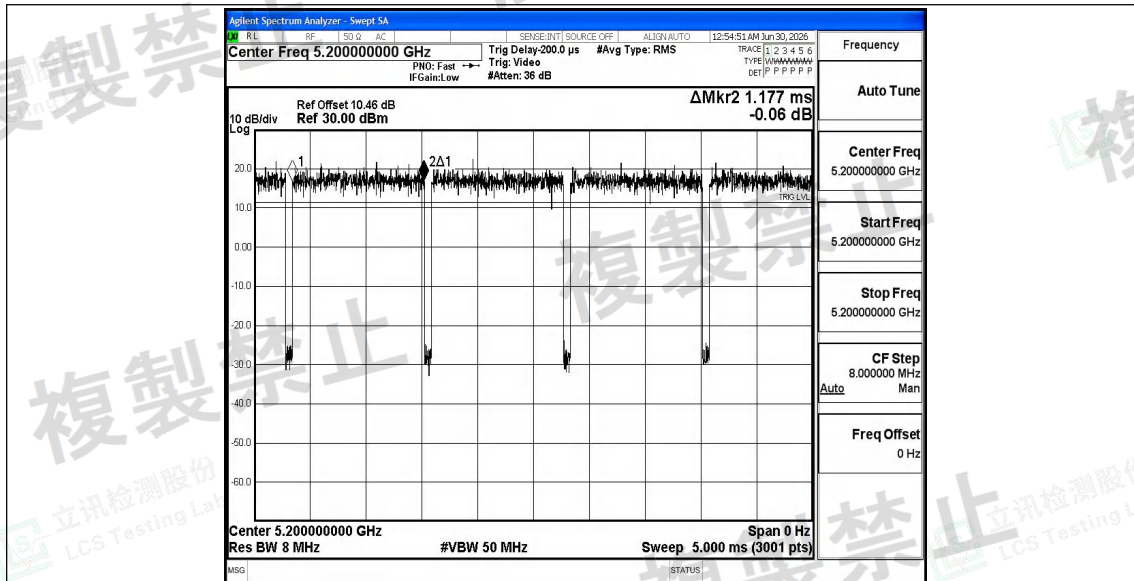

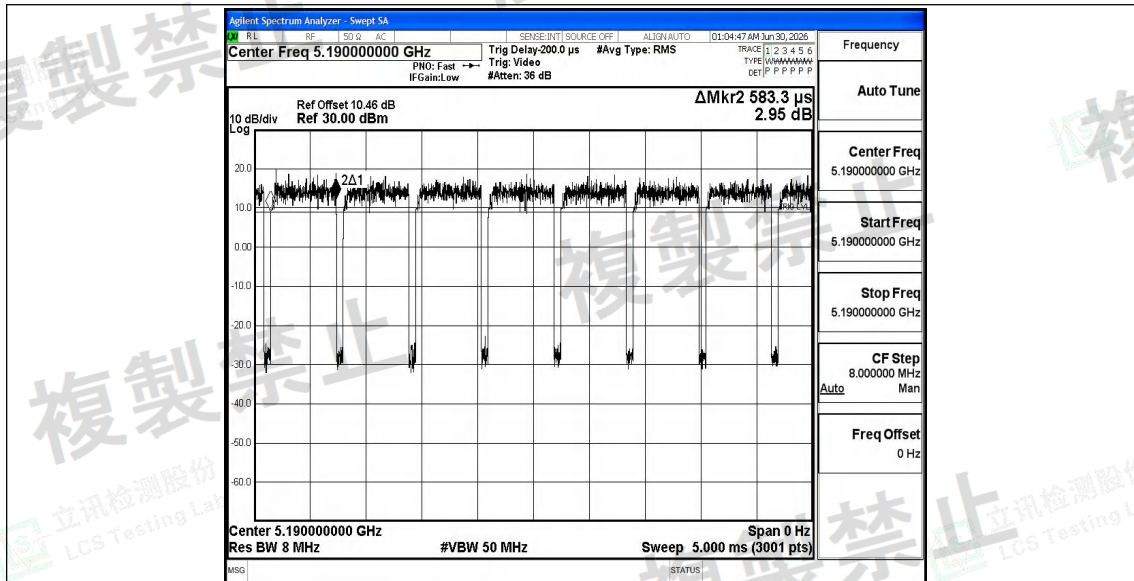


NTNV\_11N40SISO\_Ant1\_5230

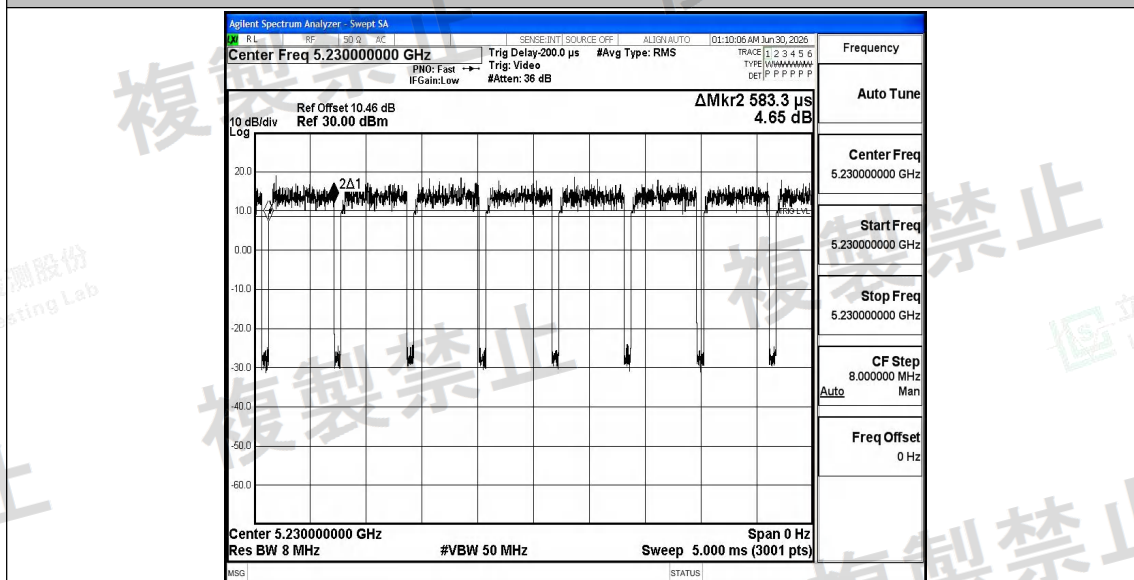


NTNV\_11AC20SISO\_Ant1\_5180




Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

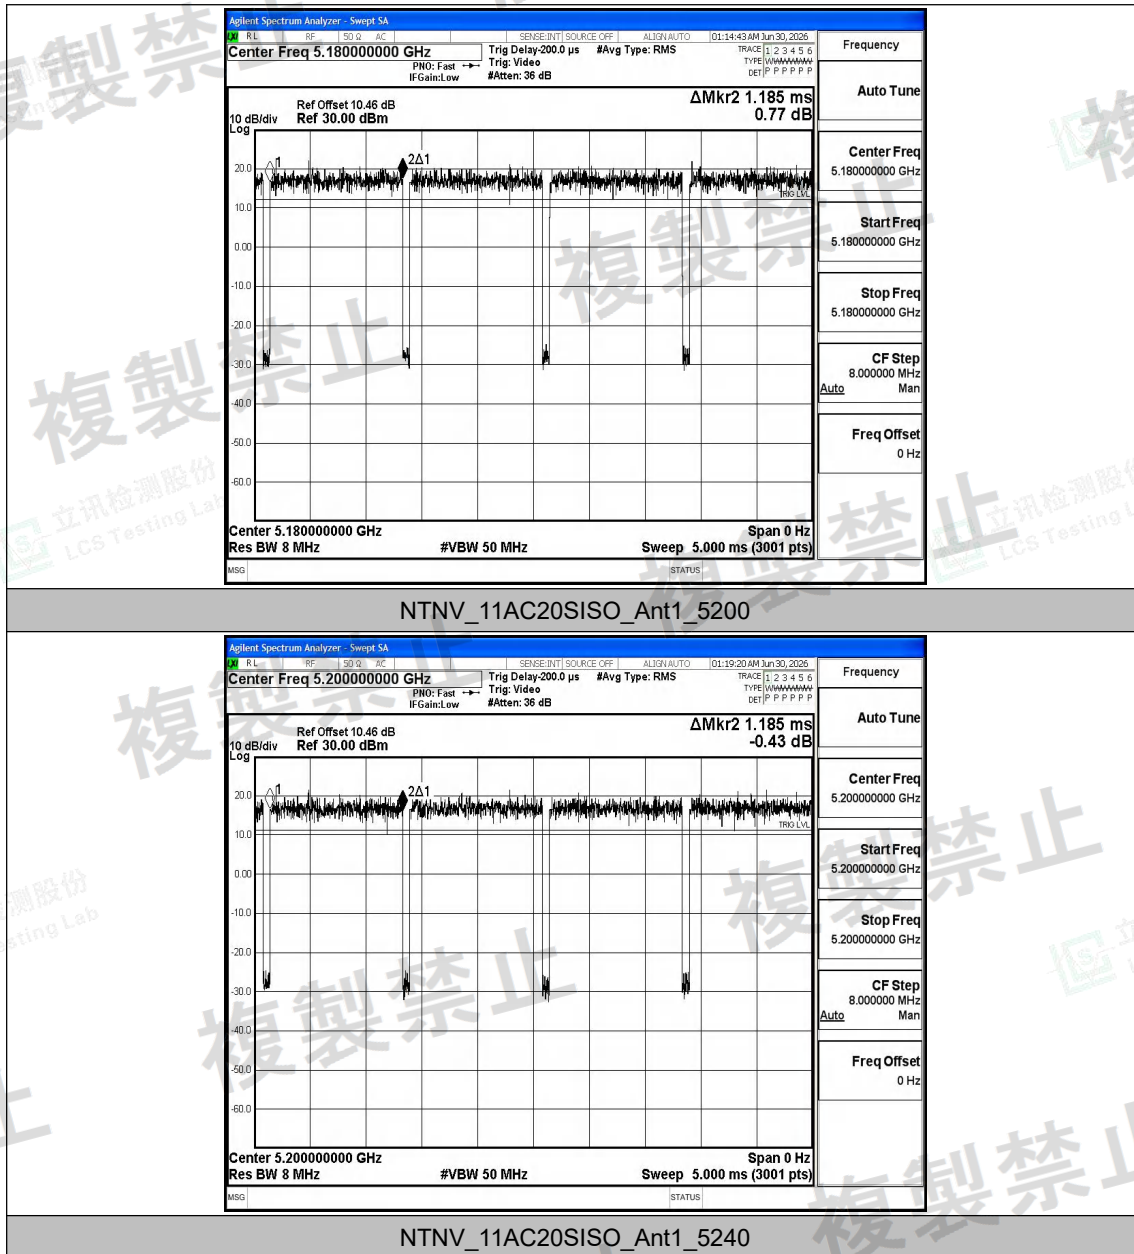

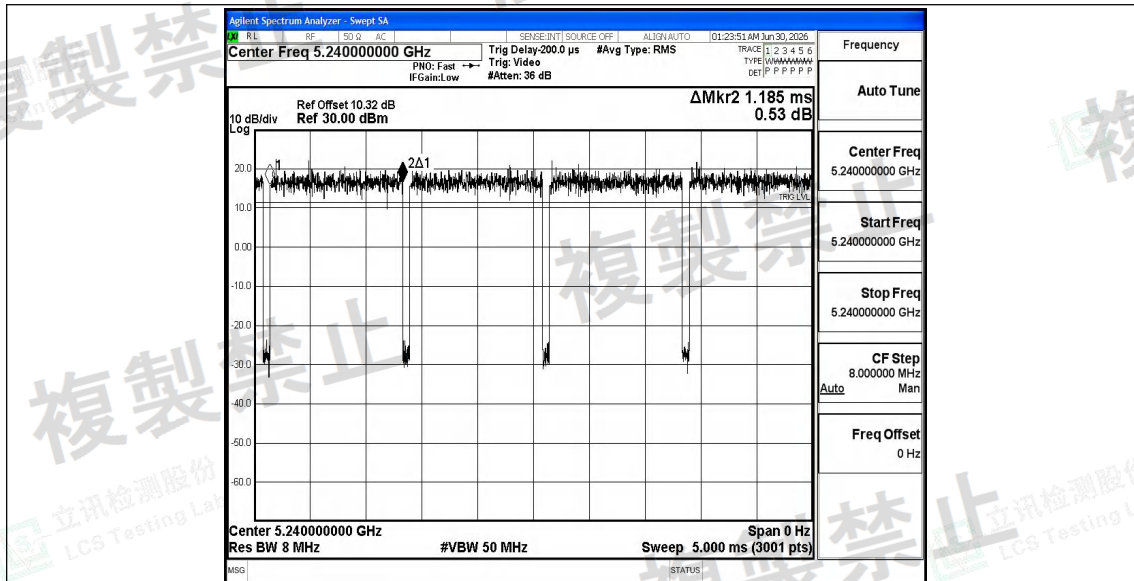


NTNV\_11AC40SISO\_Ant1\_5190

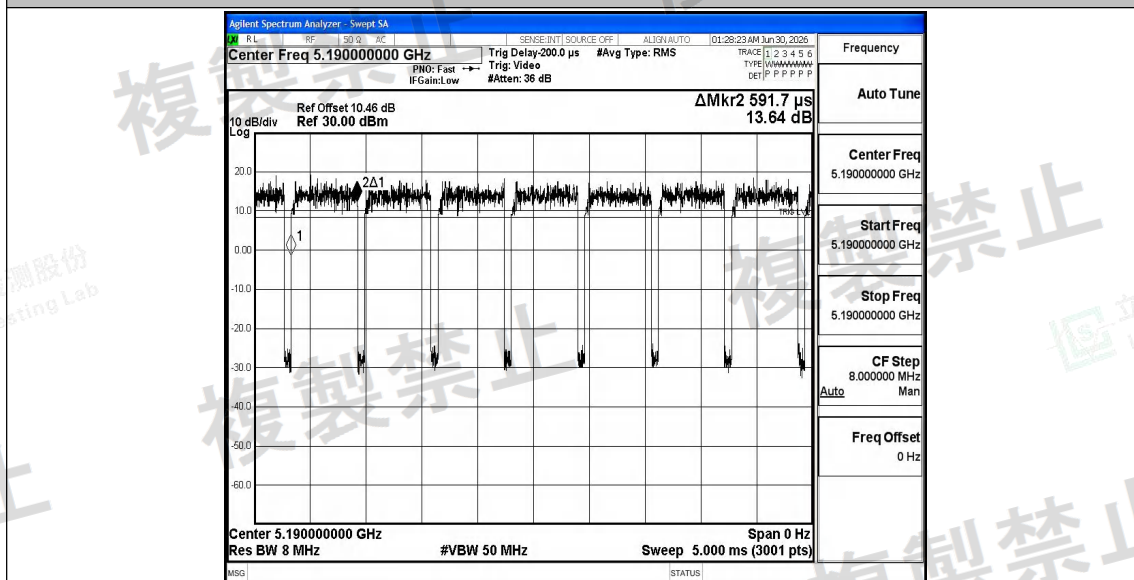


NTNV\_11AC40SISO\_Ant1\_5230



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

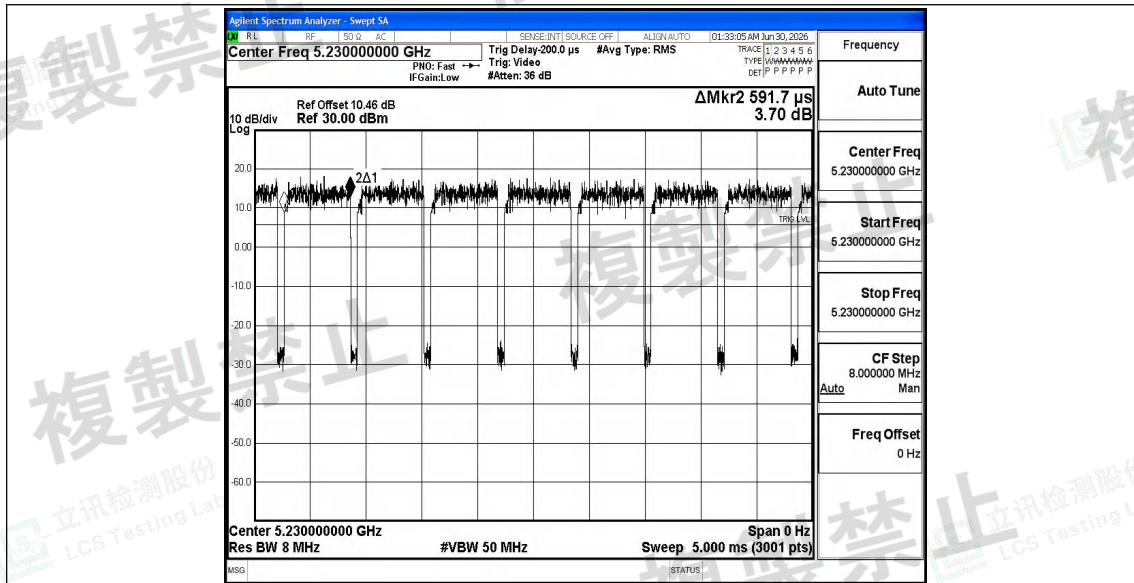


NTNV\_11AC80SISO\_Ant1\_5210

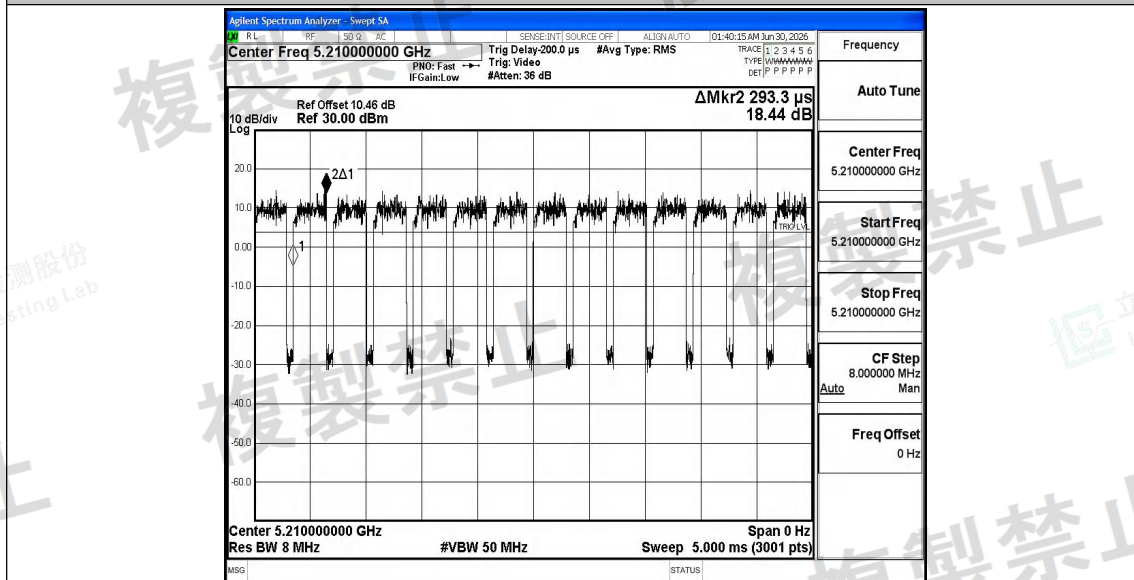


NTNV\_11AX20SISO\_Ant1\_5180



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

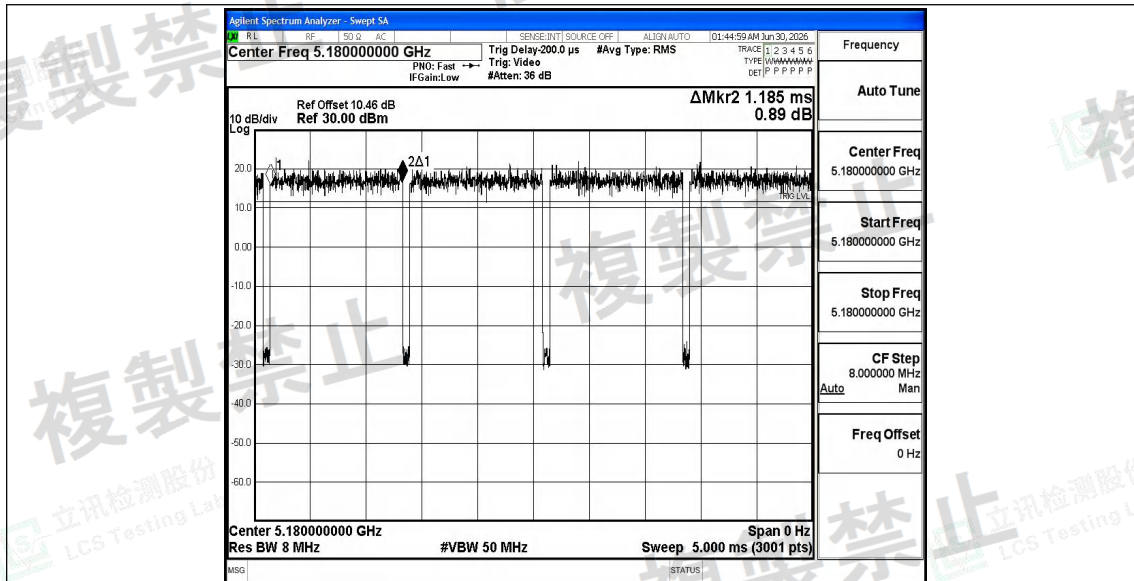


NTNV\_11AX20SISO\_Ant1\_5200

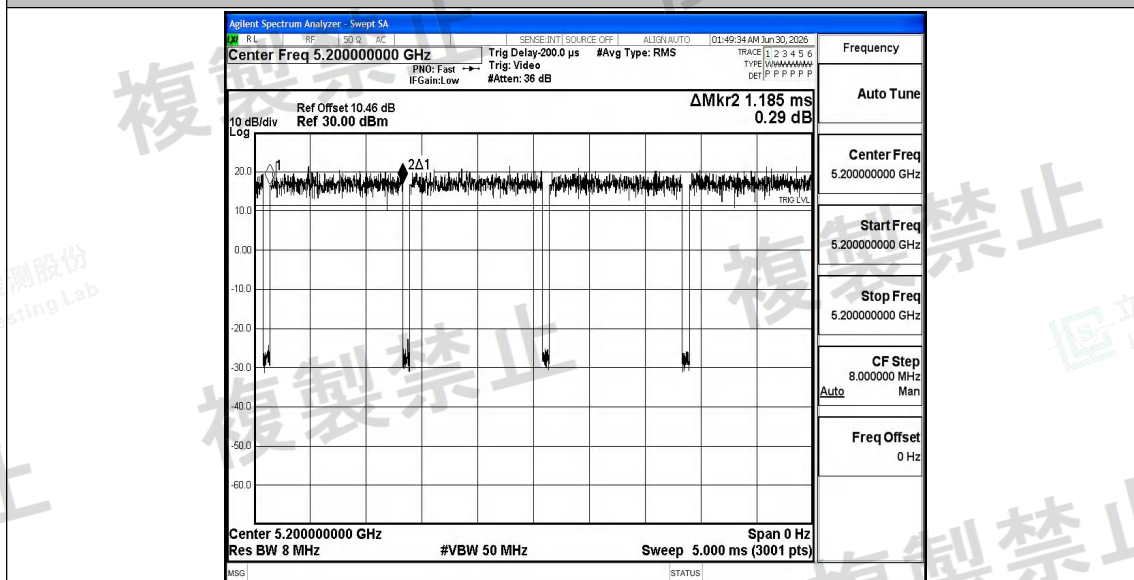


NTNV\_11AX20SISO\_Ant1\_5240



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

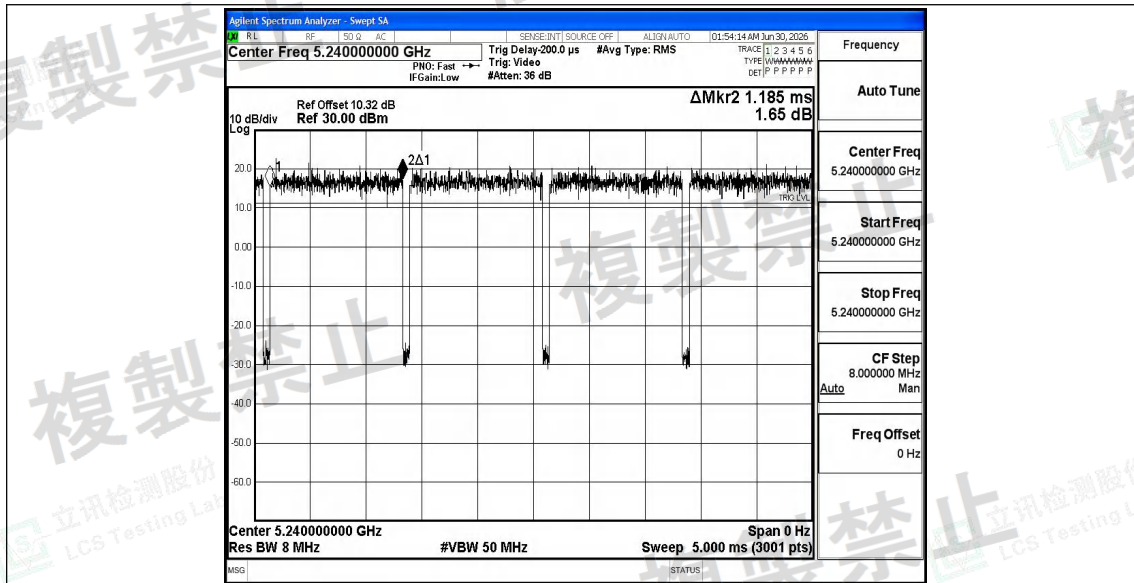


NTNV\_11AX40SISO\_Ant1\_5190

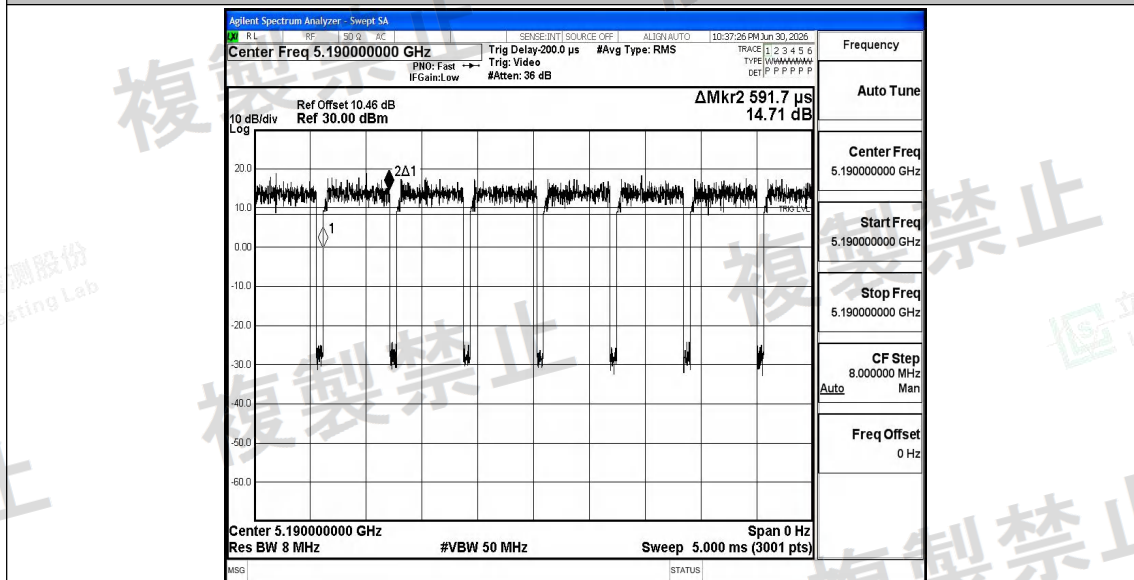

NTNV\_11AX40SISO\_Ant1\_5230



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

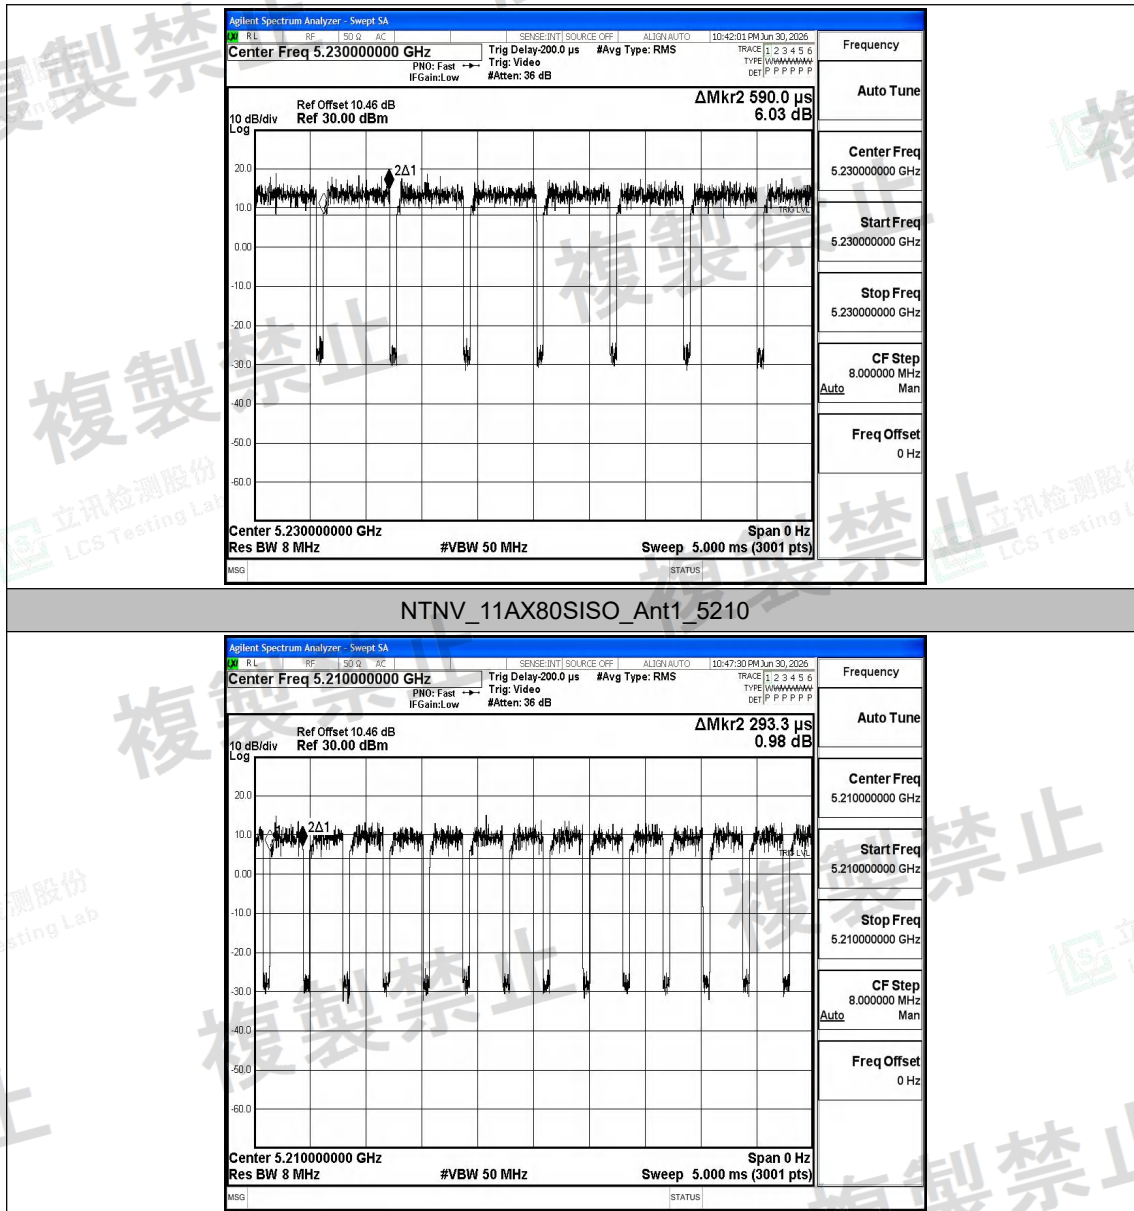

Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



## B.8 Adjacent Channel Power Tolerance

### Test Result

| TestCondition | TestMode   | Antenna | Frequency[MHz] | Offset [MHz] | Result [dBc] | Limit [dBc] | Verdict |
|---------------|------------|---------|----------------|--------------|--------------|-------------|---------|
| NTNV          | 11A        | Ant1    | 5180           | -40          | -46.80       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.68       | ≤-25        | PASS    |
|               |            |         |                | +20          | -28.46       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.54       | ≤-40        | PASS    |
|               |            |         | 5200           | -40          | -47.10       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.64       | ≤-25        | PASS    |
|               |            |         |                | +20          | -29.49       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.41       | ≤-40        | PASS    |
|               |            |         | 5240           | -40          | -47.16       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.73       | ≤-25        | PASS    |
|               |            |         |                | +20          | -29.58       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.30       | ≤-40        | PASS    |
|               | 11N20SISO  | Ant1    | 5180           | -40          | -46.28       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.62       | ≤-25        | PASS    |
|               |            |         |                | +20          | -27.93       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.96       | ≤-40        | PASS    |
|               |            |         | 5200           | -40          | -46.09       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.85       | ≤-25        | PASS    |
|               |            |         |                | +20          | -28.52       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.82       | ≤-40        | PASS    |
|               |            |         | 5240           | -40          | -46.59       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.55       | ≤-25        | PASS    |
|               |            |         |                | +20          | -29.04       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.82       | ≤-40        | PASS    |
|               | 11N40SISO  | Ant1    | 5190           | -80          | -44.67       | ≤-40        | PASS    |
|               |            |         |                | -40          | -33.11       | ≤-25        | PASS    |
|               |            |         |                | +40          | -31.59       | ≤-25        | PASS    |
|               |            |         |                | +80          | -44.19       | ≤-40        | PASS    |
|               |            |         | 5230           | -80          | -44.82       | ≤-40        | PASS    |
|               |            |         |                | -40          | -33.92       | ≤-25        | PASS    |
|               |            |         |                | +40          | -31.74       | ≤-25        | PASS    |
|               |            |         |                | +80          | -44.25       | ≤-40        | PASS    |
|               | 11AC20SISO | Ant1    | 5180           | -40          | -46.05       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.40       | ≤-25        | PASS    |
|               |            |         |                | +20          | -28.55       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.61       | ≤-40        | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



|  |            |      |      |     |        |      |      |
|--|------------|------|------|-----|--------|------|------|
|  | 11AC40SISO | Ant1 | 5200 | -40 | -46.21 | ≤-40 | PASS |
|  |            |      |      | -20 | -29.97 | ≤-25 | PASS |
|  |            |      |      | +20 | -29.07 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.89 | ≤-40 | PASS |
|  |            |      | 5240 | -40 | -46.57 | ≤-40 | PASS |
|  |            |      |      | -20 | -29.18 | ≤-25 | PASS |
|  |            |      |      | +20 | -28.78 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.50 | ≤-40 | PASS |
|  | 11AC80SISO | Ant1 | 5190 | -80 | -44.76 | ≤-40 | PASS |
|  |            |      |      | -40 | -33.03 | ≤-25 | PASS |
|  |            |      |      | +40 | -30.83 | ≤-25 | PASS |
|  |            |      |      | +80 | -44.35 | ≤-40 | PASS |
|  |            |      | 5230 | -80 | -44.81 | ≤-40 | PASS |
|  |            |      |      | -40 | -33.52 | ≤-25 | PASS |
|  |            |      |      | +40 | -31.51 | ≤-25 | PASS |
|  |            |      |      | +80 | -44.40 | ≤-40 | PASS |
|  | 11AX20SISO | Ant1 | 5210 | -80 | -34.02 | ≤-25 | PASS |
|  |            |      |      | +80 | -32.67 | ≤-25 | PASS |
|  |            |      | 5180 | -40 | -46.25 | ≤-40 | PASS |
|  |            |      |      | -20 | -29.86 | ≤-25 | PASS |
|  |            |      |      | +20 | -28.41 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.88 | ≤-40 | PASS |
|  |            |      | 5200 | -40 | -46.18 | ≤-40 | PASS |
|  |            |      |      | -20 | -29.48 | ≤-25 | PASS |
|  |            |      |      | +20 | -28.51 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.61 | ≤-40 | PASS |
|  |            |      | 5240 | -40 | -46.37 | ≤-40 | PASS |
|  |            |      |      | -20 | -29.64 | ≤-25 | PASS |
|  |            |      |      | +20 | -28.52 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.68 | ≤-40 | PASS |
|  | 11AX40SISO | Ant1 | 5190 | -80 | -44.46 | ≤-40 | PASS |
|  |            |      |      | -40 | -32.78 | ≤-25 | PASS |
|  |            |      |      | +40 | -31.25 | ≤-25 | PASS |
|  |            |      |      | +80 | -43.91 | ≤-40 | PASS |
|  |            |      | 5230 | -80 | -44.63 | ≤-40 | PASS |
|  |            |      |      | -40 | -33.31 | ≤-25 | PASS |
|  |            |      |      | +40 | -31.37 | ≤-25 | PASS |
|  |            |      |      | +80 | -44.11 | ≤-40 | PASS |
|  | 11AX80SISO | Ant1 | 5210 | -80 | -34.07 | ≤-25 | PASS |
|  |            |      |      | +80 | -32.53 | ≤-25 | PASS |



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



| TestCondition | TestMode   | Antenna | Frequency[MHz] | Offset [MHz] | Result [dBc] | Limit [dBc] | Verdict |
|---------------|------------|---------|----------------|--------------|--------------|-------------|---------|
| NTHV          | 11A        | Ant1    | 5180           | -40          | -46.85       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.72       | ≤-25        | PASS    |
|               |            |         |                | +20          | -28.49       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.57       | ≤-40        | PASS    |
|               |            |         | 5200           | -40          | -47.13       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.67       | ≤-25        | PASS    |
|               |            |         |                | +20          | -29.52       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.46       | ≤-40        | PASS    |
|               |            |         | 5240           | -40          | -47.19       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.76       | ≤-25        | PASS    |
|               |            |         |                | +20          | -29.62       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.34       | ≤-40        | PASS    |
|               | 11N20SISO  | Ant1    | 5180           | -40          | -46.31       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.66       | ≤-25        | PASS    |
|               |            |         |                | +20          | -27.96       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.98       | ≤-40        | PASS    |
|               |            |         | 5200           | -40          | -46.11       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.89       | ≤-25        | PASS    |
|               |            |         |                | +20          | -28.56       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.85       | ≤-40        | PASS    |
|               |            |         | 5240           | -40          | -46.57       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.56       | ≤-25        | PASS    |
|               |            |         |                | +20          | -29.06       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.85       | ≤-40        | PASS    |
|               | 11N40SISO  | Ant1    | 5190           | -80          | -44.69       | ≤-40        | PASS    |
|               |            |         |                | -40          | -33.14       | ≤-25        | PASS    |
|               |            |         |                | +40          | -31.63       | ≤-25        | PASS    |
|               |            |         |                | +80          | -44.24       | ≤-40        | PASS    |
|               |            |         | 5230           | -80          | -44.86       | ≤-40        | PASS    |
|               |            |         |                | -40          | -33.96       | ≤-25        | PASS    |
|               |            |         |                | +40          | -31.79       | ≤-25        | PASS    |
|               |            |         |                | +80          | -44.28       | ≤-40        | PASS    |
|               | 11AC20SISO | Ant1    | 5180           | -40          | -46.07       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.45       | ≤-25        | PASS    |
|               |            |         |                | +20          | -28.60       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.66       | ≤-40        | PASS    |
|               |            |         | 5200           | -40          | -46.25       | ≤-40        | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



|  |            |      |      |     |        |      |      |
|--|------------|------|------|-----|--------|------|------|
|  |            |      |      | -20 | -30.03 | ≤-25 | PASS |
|  |            |      |      | +20 | -29.14 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.93 | ≤-40 | PASS |
|  |            |      |      | -40 | -46.60 | ≤-40 | PASS |
|  |            |      | 5240 | -20 | -29.23 | ≤-25 | PASS |
|  |            |      |      | +20 | -28.79 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.52 | ≤-40 | PASS |
|  |            |      |      | -80 | -44.79 | ≤-40 | PASS |
|  | 11AC40SISO | Ant1 | 5190 | -40 | -33.07 | ≤-25 | PASS |
|  |            |      |      | +40 | -30.87 | ≤-25 | PASS |
|  |            |      |      | +80 | -44.36 | ≤-40 | PASS |
|  |            |      |      | -80 | -44.83 | ≤-40 | PASS |
|  |            |      | 5230 | -40 | -33.56 | ≤-25 | PASS |
|  |            |      |      | +40 | -31.55 | ≤-25 | PASS |
|  |            |      |      | +80 | -44.45 | ≤-40 | PASS |
|  |            |      |      | -80 | -34.06 | ≤-25 | PASS |
|  | 11AC80SISO | Ant1 | 5210 | +80 | -32.72 | ≤-25 | PASS |
|  |            |      |      | -40 | -46.27 | ≤-40 | PASS |
|  | 11AX20SISO | Ant1 | 5180 | -20 | -29.89 | ≤-25 | PASS |
|  |            |      |      | +20 | -28.46 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.92 | ≤-40 | PASS |
|  |            |      |      | -40 | -46.21 | ≤-40 | PASS |
|  |            |      | 5200 | -20 | -29.52 | ≤-25 | PASS |
|  |            |      |      | +20 | -28.53 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.63 | ≤-40 | PASS |
|  |            |      |      | -40 | -46.39 | ≤-40 | PASS |
|  |            |      | 5240 | -20 | -29.66 | ≤-25 | PASS |
|  |            |      |      | +20 | -28.55 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.71 | ≤-40 | PASS |
|  |            |      |      | -80 | -44.52 | ≤-40 | PASS |
|  | 11AX40SISO | Ant1 | 5190 | -40 | -32.79 | ≤-25 | PASS |
|  |            |      |      | +40 | -31.26 | ≤-25 | PASS |
|  |            |      |      | +80 | -43.93 | ≤-40 | PASS |
|  |            |      |      | -80 | -44.66 | ≤-40 | PASS |
|  |            |      | 5230 | -40 | -33.35 | ≤-25 | PASS |
|  |            |      |      | +40 | -31.39 | ≤-25 | PASS |
|  |            |      |      | +80 | -44.15 | ≤-40 | PASS |
|  |            |      |      | -80 | -34.12 | ≤-25 | PASS |
|  | 11AX80SISO | Ant1 | 5210 | +80 | -32.56 | ≤-25 | PASS |
|  |            |      |      | -80 | -34.12 | ≤-25 | PASS |





| TestCondition | TestMode   | Antenna | Frequency[MHz] | Offset [MHz] | Result [dBc] | Limit [dBc] | Verdict |
|---------------|------------|---------|----------------|--------------|--------------|-------------|---------|
| NTLV          | 11A        | Ant1    | 5180           | -40          | -46.89       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.76       | ≤-25        | PASS    |
|               |            |         |                | +20          | -28.52       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.59       | ≤-40        | PASS    |
|               |            |         | 5200           | -40          | -47.16       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.69       | ≤-25        | PASS    |
|               |            |         |                | +20          | -29.55       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.48       | ≤-40        | PASS    |
|               |            |         | 5240           | -40          | -47.18       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.78       | ≤-25        | PASS    |
|               |            |         |                | +20          | -29.66       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.36       | ≤-40        | PASS    |
|               | 11N20SISO  | Ant1    | 5180           | -40          | -46.32       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.67       | ≤-25        | PASS    |
|               |            |         |                | +20          | -27.99       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.99       | ≤-40        | PASS    |
|               |            |         | 5200           | -40          | -46.15       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.93       | ≤-25        | PASS    |
|               |            |         |                | +20          | -28.59       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.86       | ≤-40        | PASS    |
|               |            |         | 5240           | -40          | -46.59       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.58       | ≤-25        | PASS    |
|               |            |         |                | +20          | -29.09       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.86       | ≤-40        | PASS    |
|               | 11N40SISO  | Ant1    | 5190           | -80          | -44.72       | ≤-40        | PASS    |
|               |            |         |                | -40          | -33.16       | ≤-25        | PASS    |
|               |            |         |                | +40          | -31.66       | ≤-25        | PASS    |
|               |            |         |                | +80          | -44.26       | ≤-40        | PASS    |
|               |            |         | 5230           | -80          | -44.87       | ≤-40        | PASS    |
|               |            |         |                | -40          | -33.97       | ≤-25        | PASS    |
|               |            |         |                | +40          | -31.82       | ≤-25        | PASS    |
|               |            |         |                | +80          | -44.29       | ≤-40        | PASS    |
|               | 11AC20SISO | Ant1    | 5180           | -40          | -46.09       | ≤-40        | PASS    |
|               |            |         |                | -20          | -29.48       | ≤-25        | PASS    |
|               |            |         |                | +20          | -28.65       | ≤-25        | PASS    |
|               |            |         |                | +40          | -45.69       | ≤-40        | PASS    |
|               |            |         | 5200           | -40          | -46.27       | ≤-40        | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



|  |            |      |      |     |        |      |      |
|--|------------|------|------|-----|--------|------|------|
|  |            |      |      | -20 | -30.06 | ≤-25 | PASS |
|  |            |      |      | +20 | -29.17 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.95 | ≤-40 | PASS |
|  |            |      | 5240 | -40 | -46.65 | ≤-40 | PASS |
|  |            |      |      | -20 | -29.26 | ≤-25 | PASS |
|  |            |      |      | +20 | -28.82 | ≤-25 | PASS |
|  |            |      | 5190 | +40 | -45.56 | ≤-40 | PASS |
|  |            |      |      | -80 | -44.83 | ≤-40 | PASS |
|  |            |      |      | -40 | -33.09 | ≤-25 | PASS |
|  | 11AC40SISO | Ant1 | 5230 | +40 | -30.89 | ≤-25 | PASS |
|  |            |      |      | +80 | -44.37 | ≤-40 | PASS |
|  |            |      |      | -80 | -44.85 | ≤-40 | PASS |
|  |            |      | 5210 | -40 | -33.59 | ≤-25 | PASS |
|  |            |      |      | +40 | -31.56 | ≤-25 | PASS |
|  |            |      |      | +80 | -44.47 | ≤-40 | PASS |
|  | 11AC80SISO | Ant1 | 5180 | -80 | -34.09 | ≤-25 | PASS |
|  |            |      |      | +80 | -32.75 | ≤-25 | PASS |
|  |            |      |      | -40 | -46.29 | ≤-40 | PASS |
|  | 11AX20SISO | Ant1 | 5200 | -20 | -29.92 | ≤-25 | PASS |
|  |            |      |      | +20 | -28.52 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.95 | ≤-40 | PASS |
|  |            |      | 5240 | -40 | -46.26 | ≤-40 | PASS |
|  |            |      |      | -20 | -29.55 | ≤-25 | PASS |
|  |            |      |      | +20 | -28.54 | ≤-25 | PASS |
|  |            |      | 5190 | +40 | -45.65 | ≤-40 | PASS |
|  |            |      |      | -40 | -46.42 | ≤-40 | PASS |
|  |            |      |      | -20 | -29.69 | ≤-25 | PASS |
|  | 11AX40SISO | Ant1 | 5230 | +20 | -28.59 | ≤-25 | PASS |
|  |            |      |      | +40 | -45.73 | ≤-40 | PASS |
|  |            |      |      | -80 | -44.55 | ≤-40 | PASS |
|  |            |      | 5210 | -40 | -32.82 | ≤-25 | PASS |
|  |            |      |      | +40 | -31.29 | ≤-25 | PASS |
|  |            |      |      | +80 | -43.95 | ≤-40 | PASS |
|  | 11AX80SISO | Ant1 | 5240 | -80 | -44.68 | ≤-40 | PASS |
|  |            |      |      | -40 | -33.37 | ≤-25 | PASS |
|  |            |      |      | +40 | -31.42 | ≤-25 | PASS |
|  | 11AX80SISO | Ant1 | 5210 | +80 | -44.18 | ≤-40 | PASS |
|  |            |      |      | -80 | -34.16 | ≤-25 | PASS |
|  |            |      |      | +80 | -32.59 | ≤-25 | PASS |


Remark: only recorded the plots of worst data(NTNV) in the report.




Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity




## Test Graphs

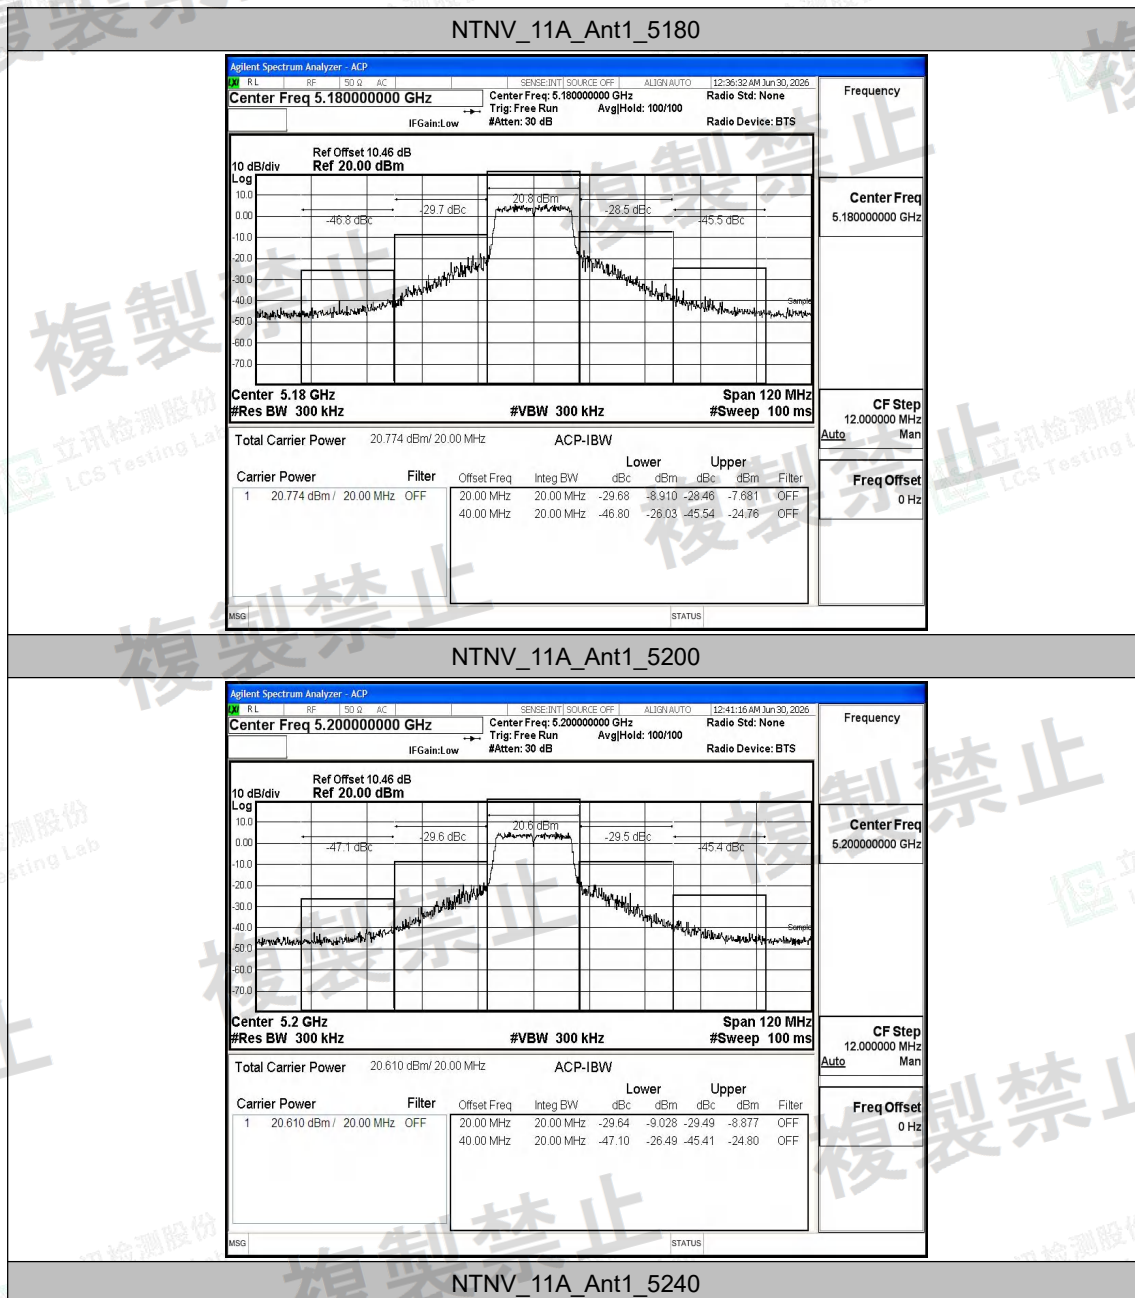

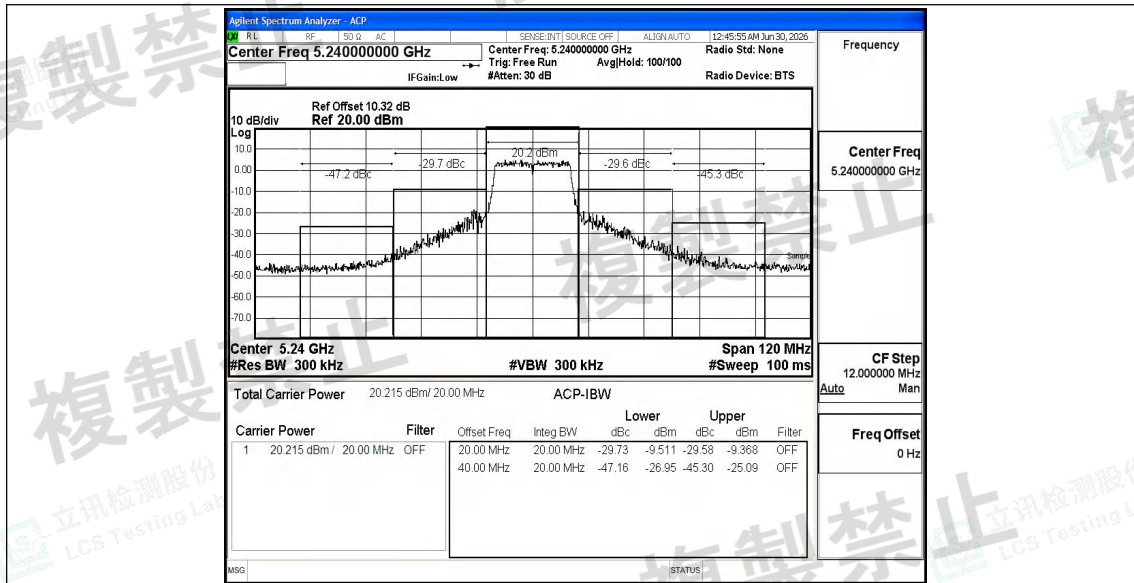


NTNV\_11N20SISO\_Ant1\_5180

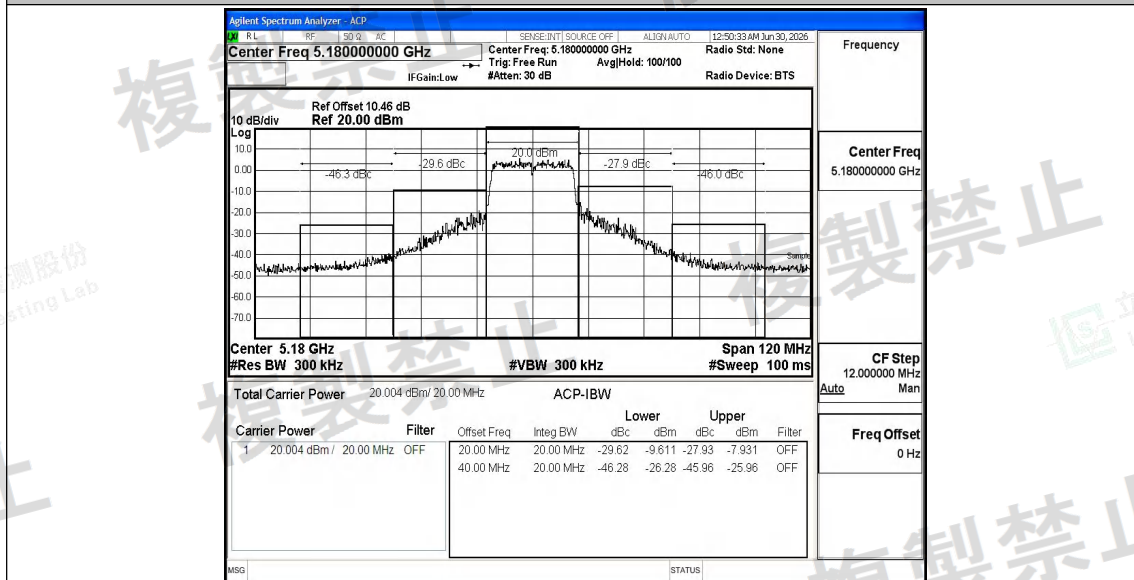


NTNV\_11N20SISO\_Ant1\_5200



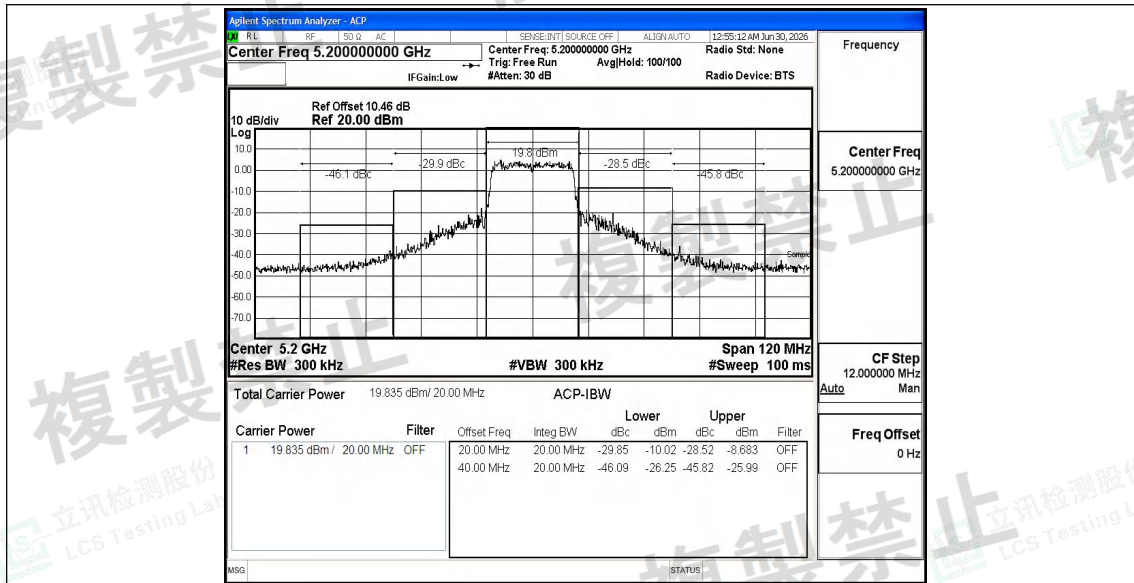


NTNV\_11N20SISO\_Ant1\_5240

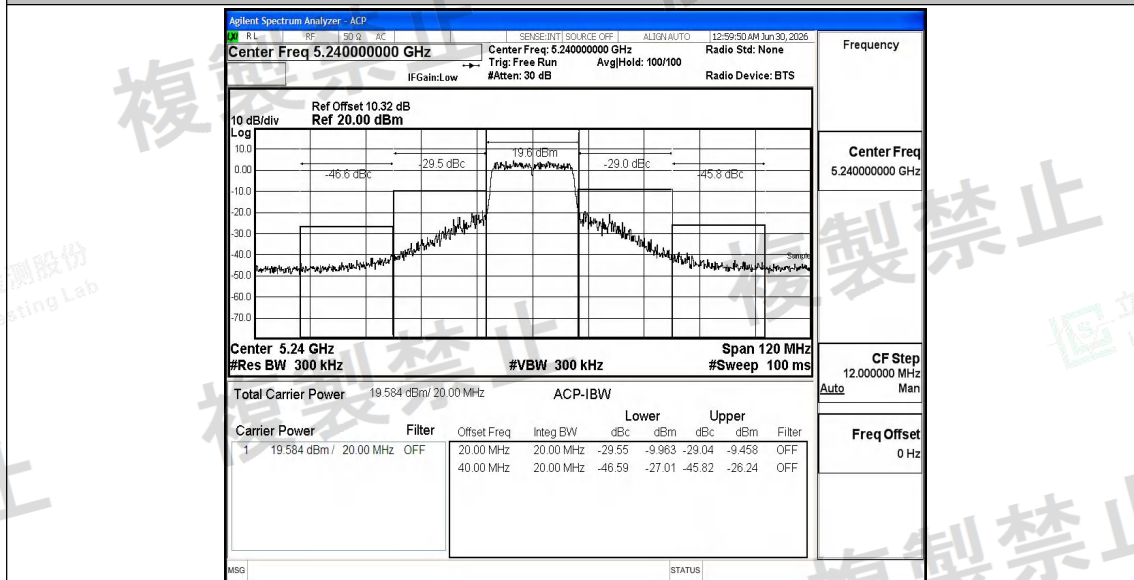


NTNV\_11N40SISO\_Ant1\_5190



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

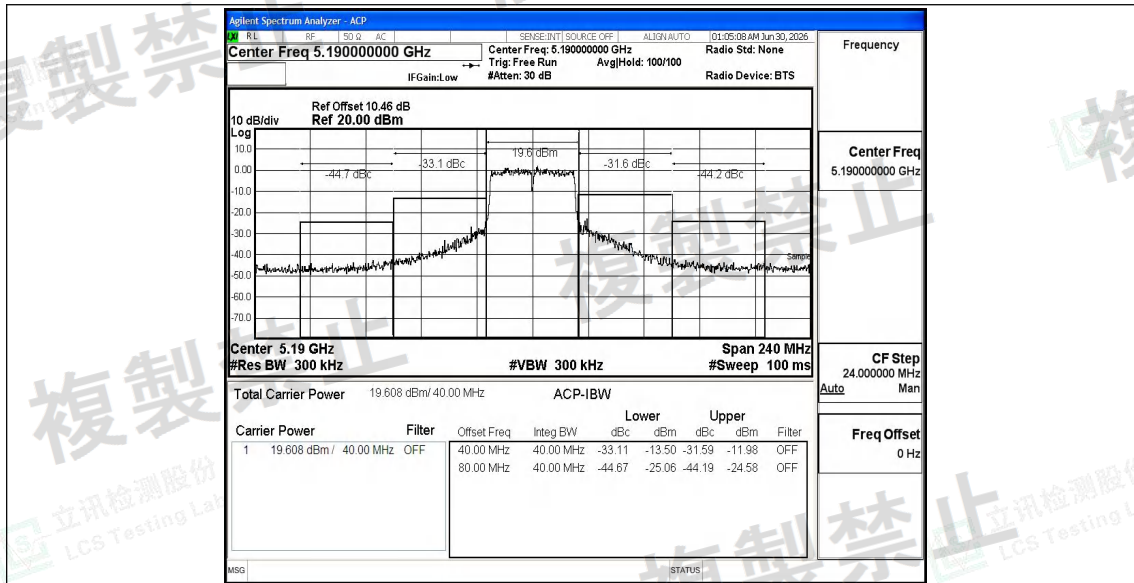



NTNV\_11N40SISO\_Ant1\_5230

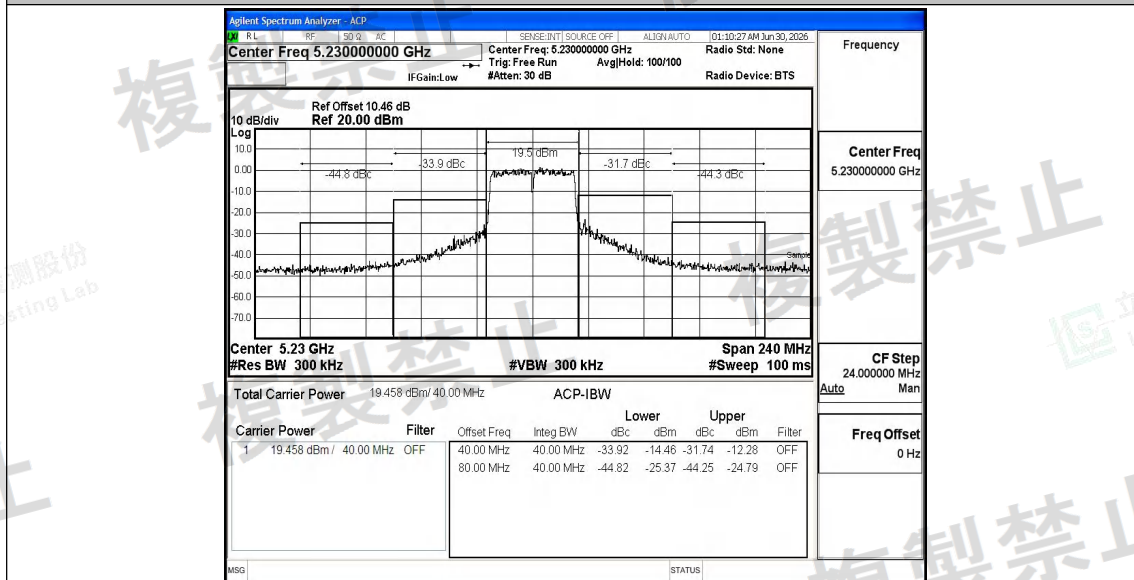


NTNV\_11AC20SISO\_Ant1\_5180




Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

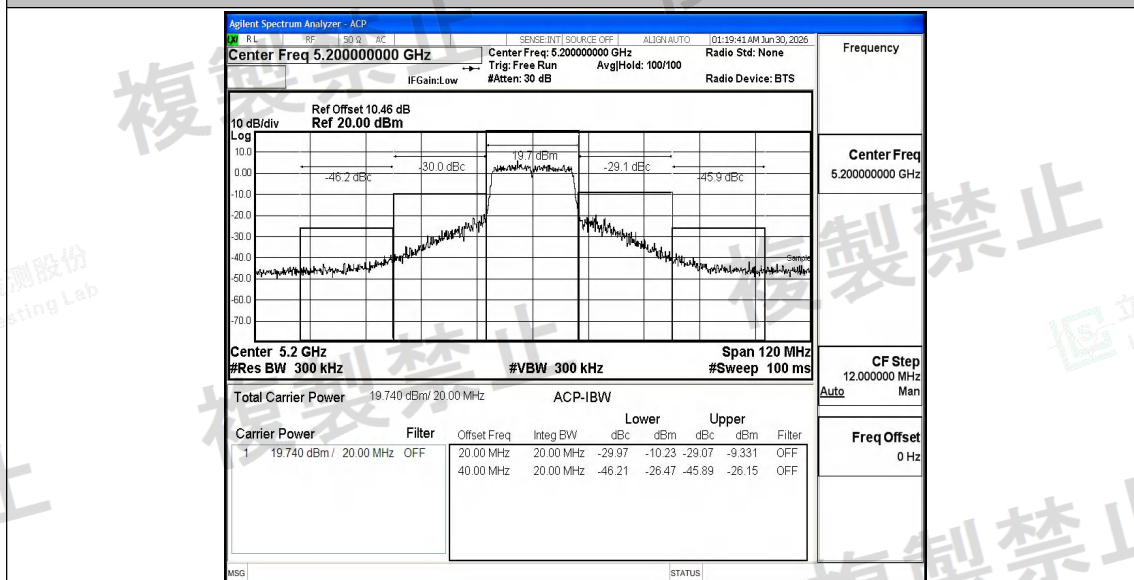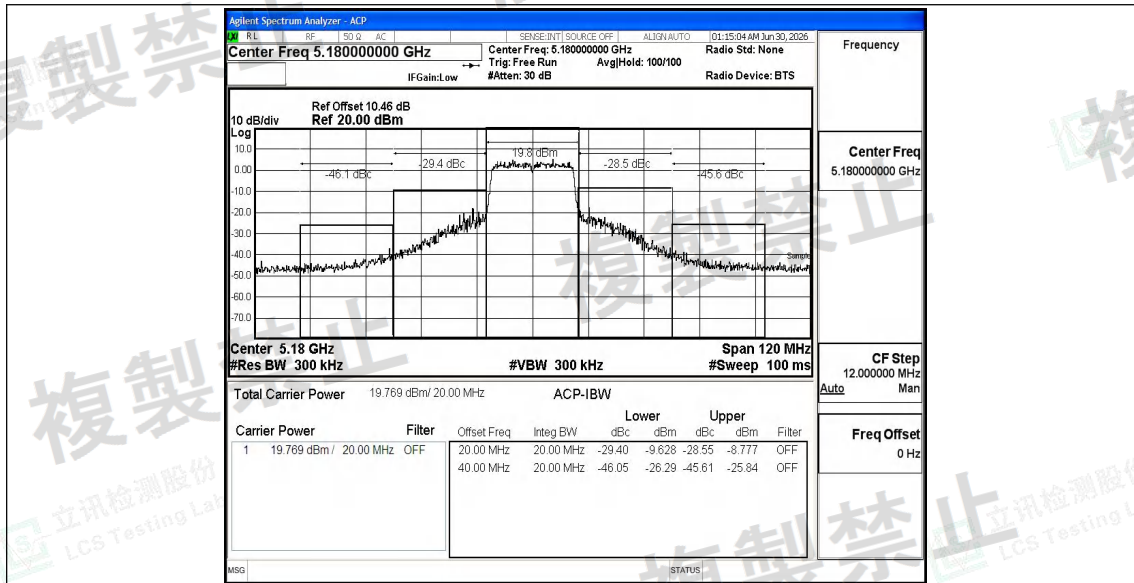

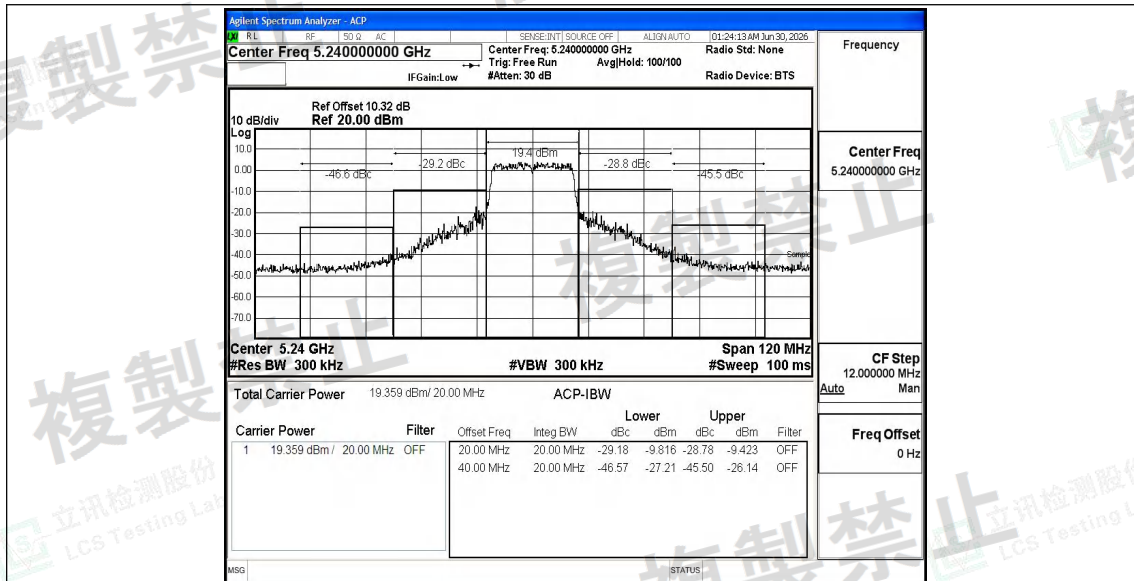


NTNV\_11AC40SISO\_Ant1\_5190

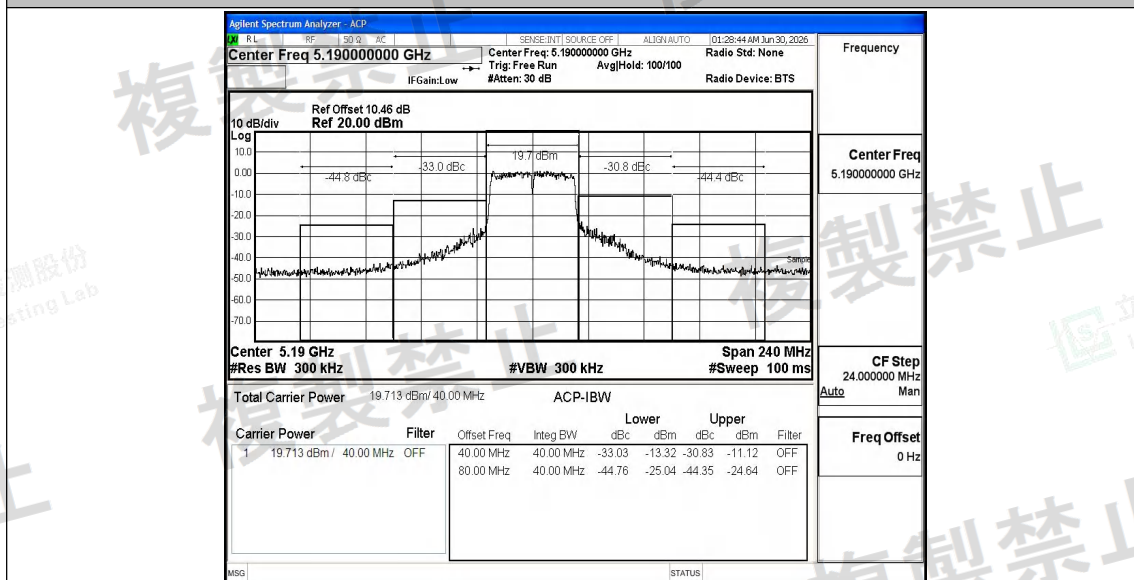


NTNV\_11AC40SISO\_Ant1\_5230



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity


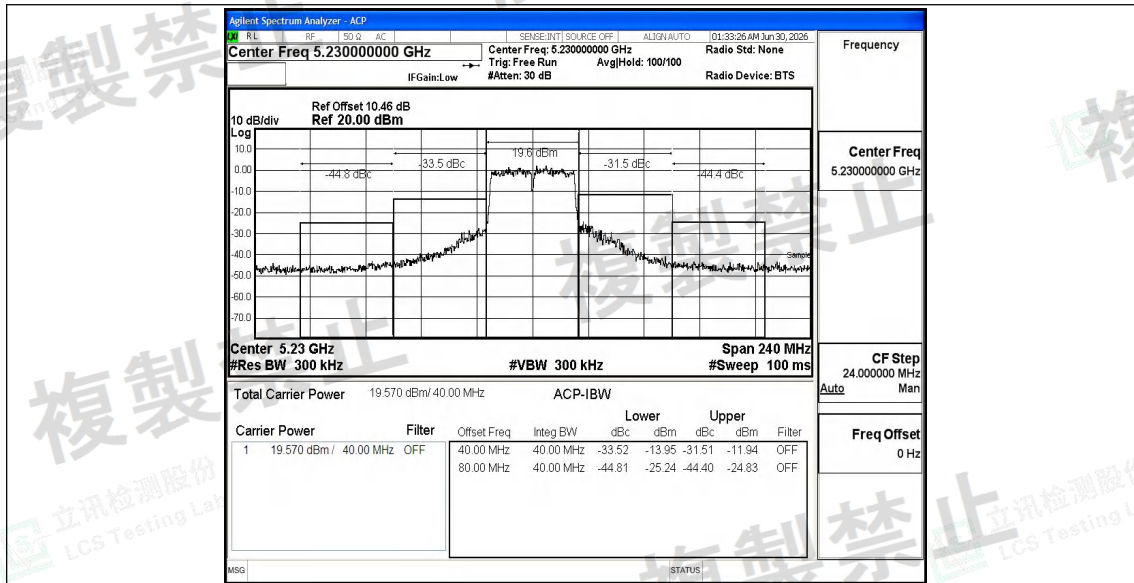



NTNV\_11AC80SISO\_Ant1\_5210

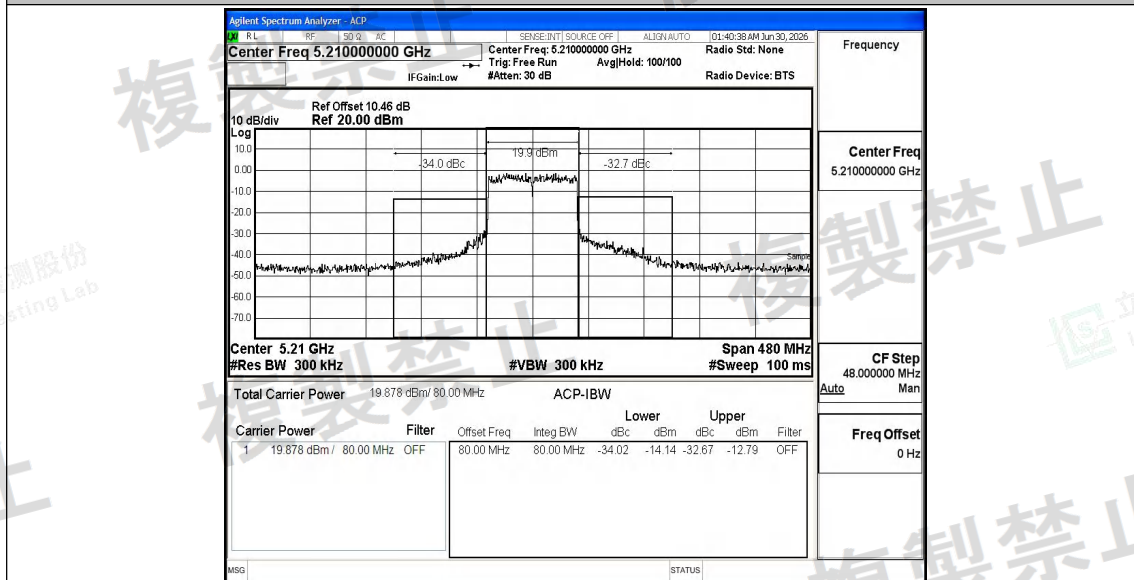


NTNV\_11AX20SISO\_Ant1\_5180



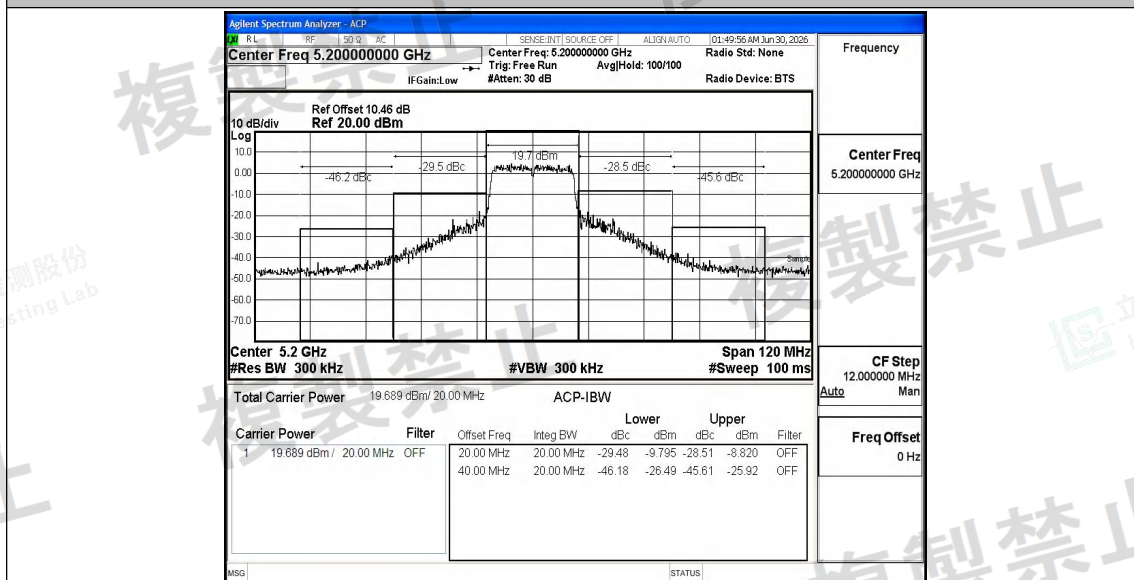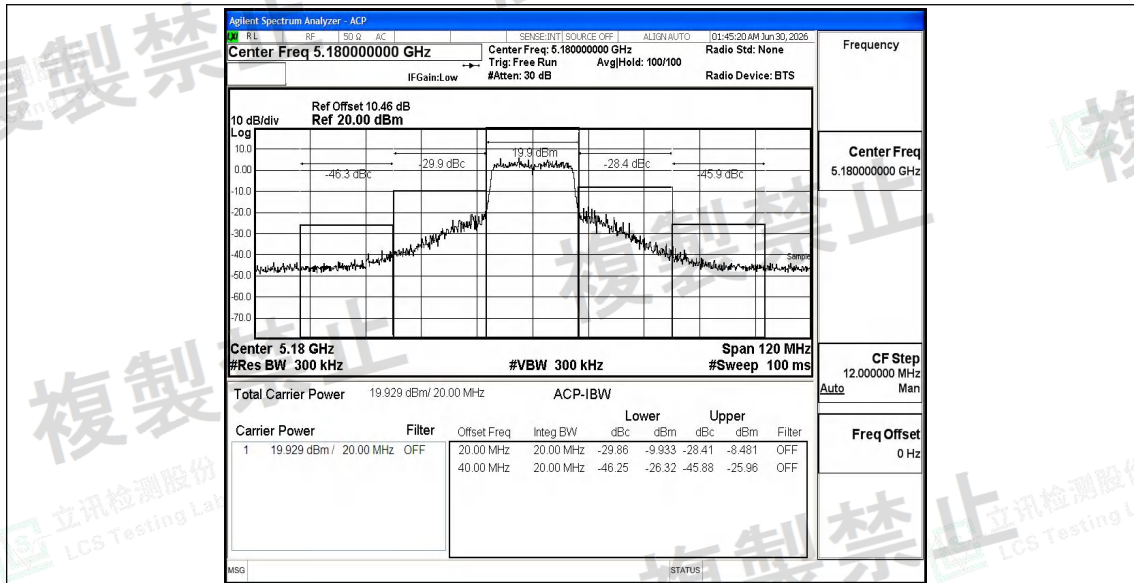

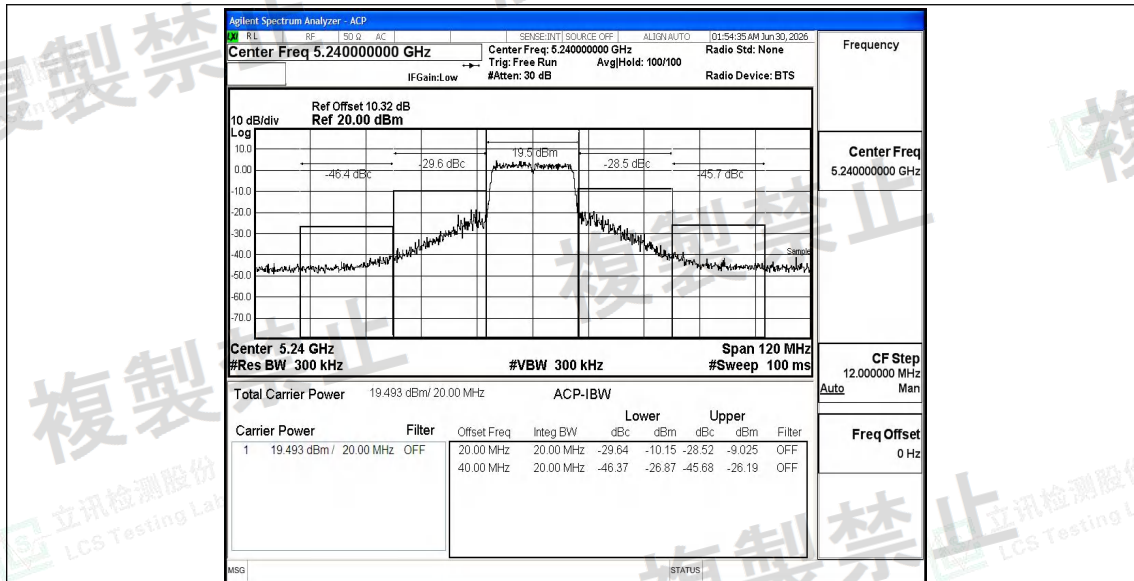

NTNV\_11AX40SISO\_Ant1\_5190

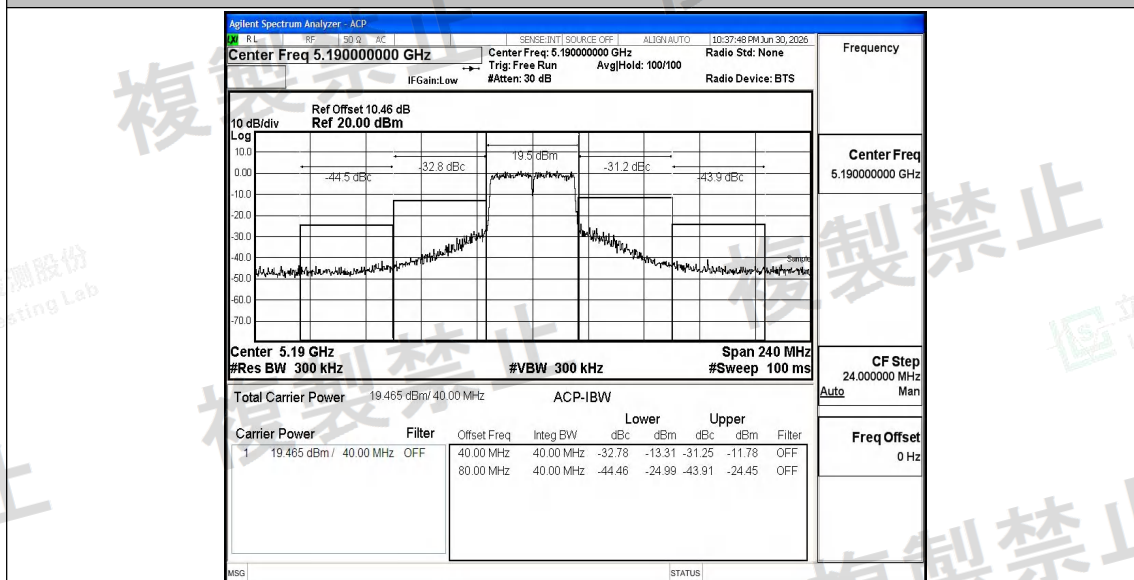

NTNV\_11AX40SISO\_Ant1\_5230



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: Room 101/201, Building A, and Room 101/301, Building C, Juji Industrial Park, Yabianxueziwei, Shajing Subdistrict, Bao'an District, Shenzhen, Guangdong, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity

