



報告編號 : 4790091528-TW-R1-V0
頁碼 : 122 of 165
報告發行日期 : 2022/1/10

Mode	802.11ax(HE40)	Channel	142
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11420	29.83	18.8	48.63	74	-25.37	PK
Vertical	*	11420	30.22	18.8	49.02	74	-24.98	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan
Telephone :+886-2-7737-3000
Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0
頁碼 : 123 of 165
報告發行日期 : 2022/1/10

TX, 802.11ax(HE40) (Ch 142)

Radiated Spurious Emission, Horizontal

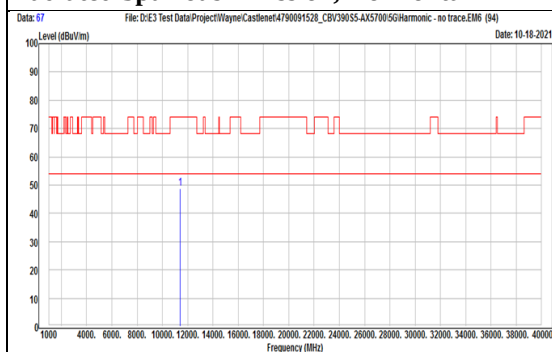

TX, 802.11ax(HE40) (Ch 142)

Radiated Spurious Emission, Vertical



Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 124 of 165

報告發行日期 : 2022/1/10

Mode	802.11ax(HE40)	Channel	151
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5649	51.62	14	65.62	68.2	-2.58	PK
		5699	68.4	14.05	82.45	104.46	-22.01	PK
	@	5755	102.12	14.33	116.45	N/A	N/A	PK
		11510	47.25	19.03	66.28	74	-7.72	PK
		11510	33.08	19.03	52.11	54	-1.89	AVG
Vertical		5647	45.44	14.01	59.45	68.2	-8.75	PK
		5700	58.75	14.05	72.8	105.2	-32.4	PK
	@	5755	100.56	14.33	114.89	N/A	N/A	PK
		11510	41.73	19.03	60.76	74	-13.24	PK
		11510	30.84	19.03	49.87	54	-4.13	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




報告編號 : 4790091528-TW-R1-V0

頁碼 : 125 of 165

報告發行日期 : 2022/1/10


TX, 802.11ax(HE40) (Ch 151)

Radiated Spurious Emission, Horizontal

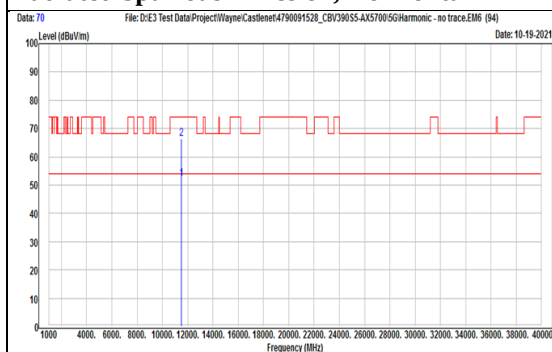


TX, 802.11ax(HE40) (Ch 151)

Radiated Spurious Emission, Vertical

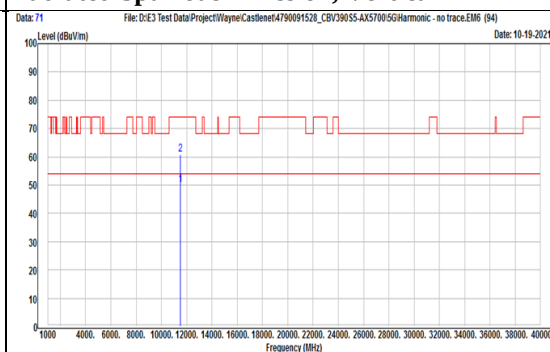


TX, 802.11ax(HE40) (Ch 151)

Band Edge (Peak), Horizontal

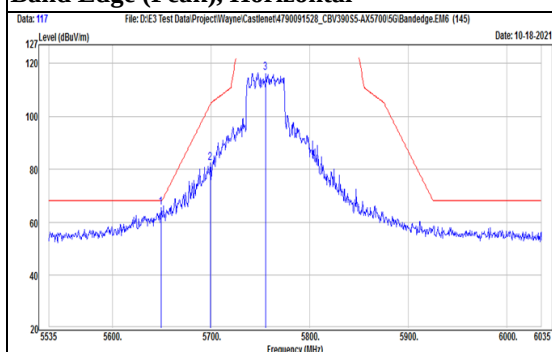

TX, 802.11ax(HE40) (Ch 151)

Band Edge (Peak), Vertical

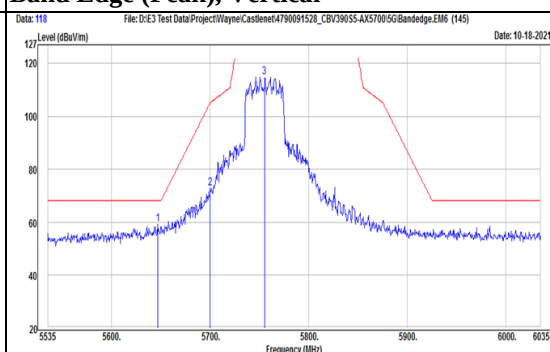

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 126 of 165

報告發行日期 : 2022/1/10

Mode	802.11ax(HE40)	Channel	159
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5795	102.45	14.53	116.98	N/A	N/A	PK
		5875	56.43	14.89	71.32	105.2	-33.88	PK
		5936	46.93	15	61.93	68.2	-6.27	PK
		11590	47.61	18.84	66.45	74	-7.55	PK
		11590	34.29	18.84	53.13	54	-0.87	AVG
Vertical	@	5795	101.43	14.53	115.96	N/A	N/A	PK
		5879	53.27	14.9	68.17	102.23	-34.06	PK
		5948.5	43.59	15.02	58.61	68.2	-9.59	PK
		11590	40.76	18.84	59.6	74	-14.4	PK
		11590	29.45	18.84	48.29	54	-5.71	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




報告編號 : 4790091528-TW-R1-V0

頁碼 : 127 of 165

報告發行日期 : 2022/1/10

TX, 802.11ax(HE40) (Ch 159)

Radiated Spurious Emission, Horizontal

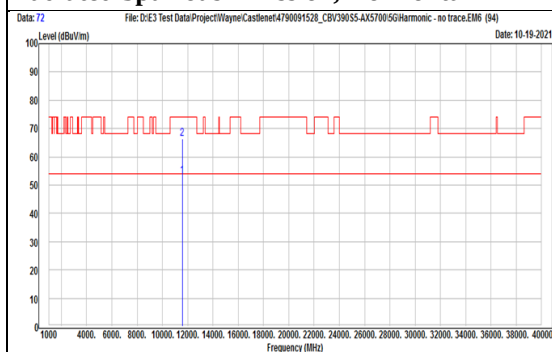


TX, 802.11ax(HE40) (Ch 159)

Radiated Spurious Emission, Vertical




TX, 802.11ax(HE40) (Ch 159)

Band Edge (Peak), Horizontal

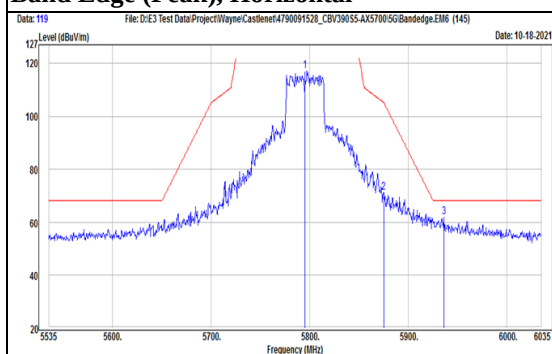

TX, 802.11ax(HE40) (Ch 159)

Band Edge (Peak), Vertical

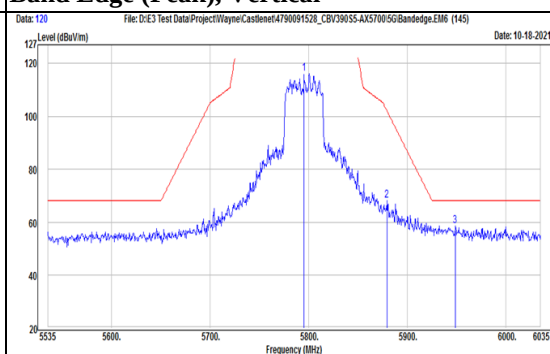

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 128 of 165

報告發行日期 : 2022/1/10

Mode	802.11ax(HE80)	Channel	42
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5117.25	48.89	13.46	62.35	74	-11.65	PK
		5147	39.57	13.43	53	54	-1	AVG
	@	5210	91.51	13.36	104.87	N/A	N/A	PK
	@	5210	83.29	13.36	96.65	N/A	N/A	AVG
	*	10420	30.61	17.6	48.21	68.2	-19.99	PK
Vertical		5036.4	43.02	13.15	56.17	74	-17.83	PK
		5148.75	32.32	13.42	45.74	54	-8.26	AVG
	@	5210	89.01	13.36	102.37	N/A	N/A	PK
	@	5210	78.61	13.36	91.97	N/A	N/A	AVG
	*	10420	31.29	17.6	48.89	68.2	-19.31	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




報告編號 : 4790091528-TW-R1-V0

頁碼 : 129 of 165

報告發行日期 : 2022/1/10


TX, 802.11ax(HE80) (Ch 42)

Radiated Spurious Emission, Horizontal

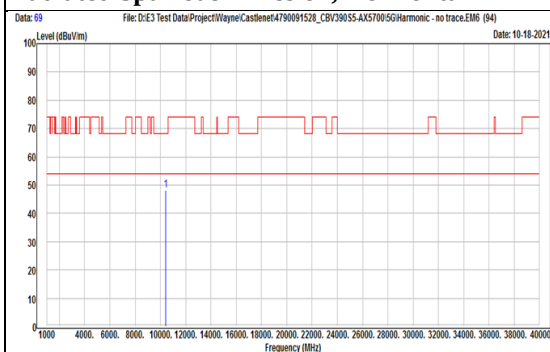


TX, 802.11ax(HE80) (Ch 42)

Radiated Spurious Emission, Vertical

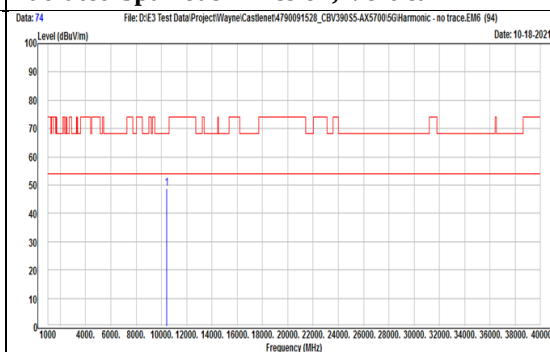


TX, 802.11ax(HE80) (Ch 42)

Band Edge (Average), Horizontal

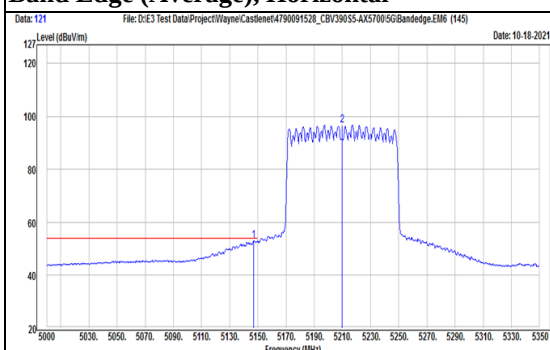


TX, 802.11ax(HE80) (Ch 42)

Band Edge (Average), Vertical

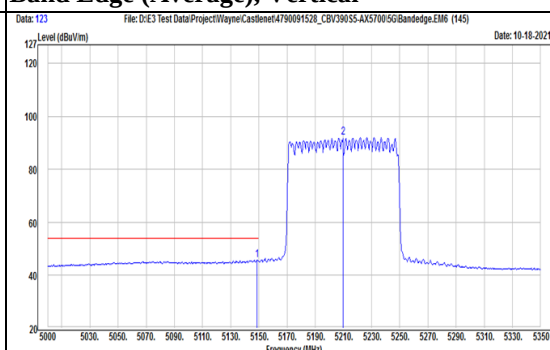


TX, 802.11ax(HE80) (Ch 42)

Band Edge (Peak), Horizontal

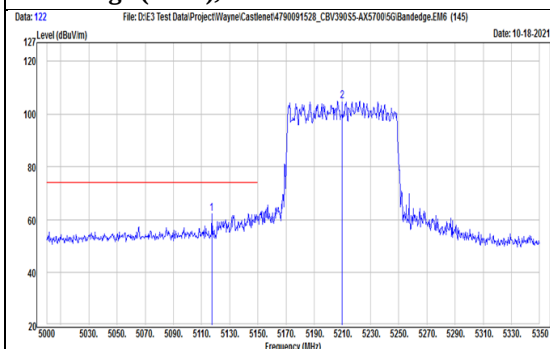

TX, 802.11ax(HE80) (Ch 42)

Band Edge (Peak), Vertical

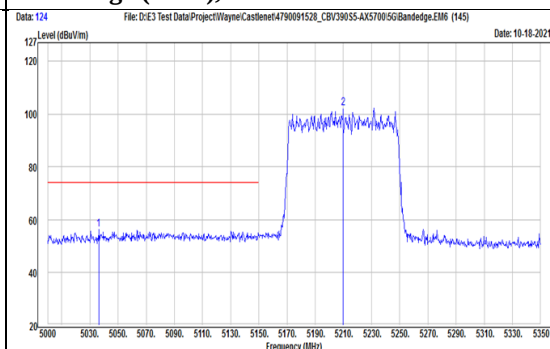

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 130 of 165

報告發行日期 : 2022/1/10

Mode	802.11ax(HE80)	Channel	58
------	----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	@	5290	94.2	13.21	107.41	N/A	N/A	PK
	@	5290	83.48	13.21	96.69	N/A	N/A	AVG
		5352.3	40.51	13.26	53.77	54	-0.23	AVG
		5369.7	48.76	13.33	62.09	74	-11.91	PK
	*	10580	30.12	17.73	47.85	68.2	-20.35	PK
Vertical	@	5290	89.65	13.21	102.86	N/A	N/A	PK
	@	5290	81.36	13.21	94.57	N/A	N/A	AVG
		5352	33.98	13.26	47.24	54	-6.76	AVG
		5365.5	44.45	13.31	57.76	74	-16.24	PK
	*	10580	31.56	17.73	49.29	68.2	-18.91	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




報告編號 : 4790091528-TW-R1-V0

頁碼 : 131 of 165

報告發行日期 : 2022/1/10


TX, 802.11ax(HE80) (Ch 58)

Radiated Spurious Emission, Horizontal

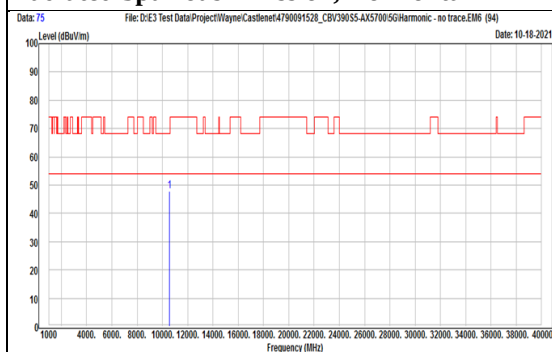


TX, 802.11ax(HE80) (Ch 58)

Radiated Spurious Emission, Vertical

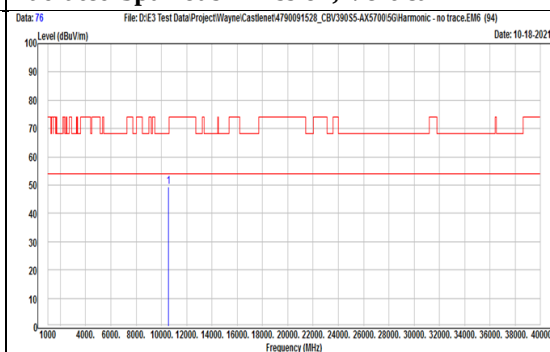


TX, 802.11ax(HE80) (Ch 58)

Band Edge (Average), Horizontal

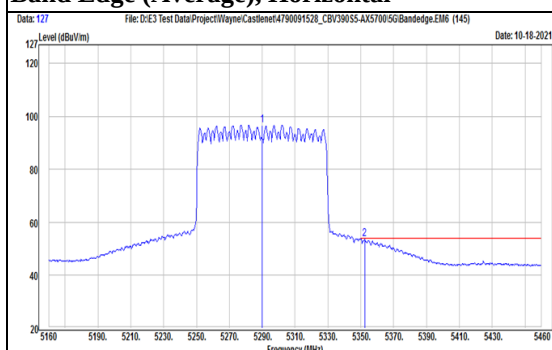


TX, 802.11ax(HE80) (Ch 58)

Band Edge (Average), Vertical

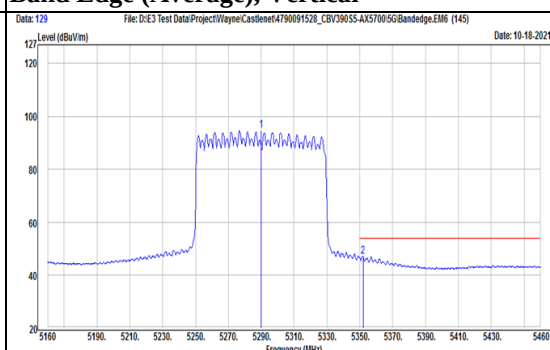


TX, 802.11ax(HE80) (Ch 58)

Band Edge (Peak), Horizontal

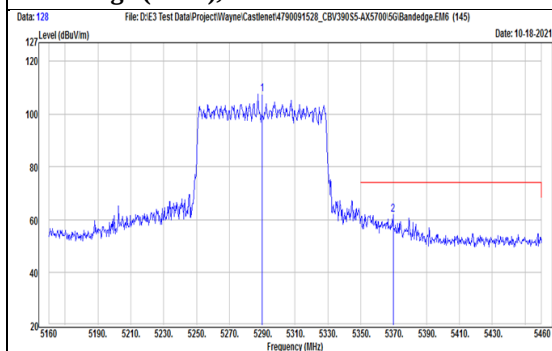

TX, 802.11ax(HE80) (Ch 58)

Band Edge (Peak), Vertical

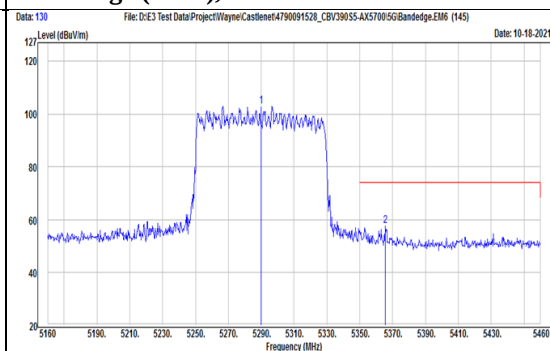

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 132 of 165

報告發行日期 : 2022/1/10

Mode	802.11ax(HE80)	Channel	106
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5457.75	48.8	13.7	62.5	74	-11.5	PK
		5457.75	39.16	13.7	52.86	54	-1.14	AVG
		5465.45	51.24	13.72	64.96	68.2	-3.24	PK
	@	5530	90.48	13.87	104.35	N/A	N/A	PK
	@	5530	82.11	13.87	95.98	N/A	N/A	AVG
	*	11060	29.98	18.41	48.39	74	-25.61	PK
Vertical		5459.5	41.52	13.7	55.22	74	-18.78	PK
		5459.5	33.98	13.7	47.68	54	-6.32	AVG
		5466.5	44.43	13.72	58.15	68.2	-10.05	PK
	@	5530	87.7	13.87	101.57	N/A	N/A	PK
	@	5530	80.73	13.87	94.6	N/A	N/A	AVG
	*	11060	30.66	18.41	49.07	74	-24.93	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




TX, 802.11ax(HE80) (Ch 106)

Radiated Spurious Emission, Horizontal

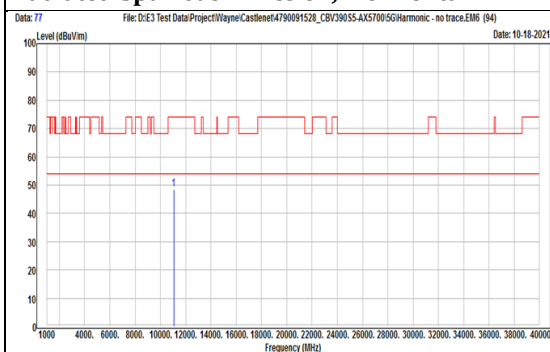


TX, 802.11ax(HE80) (Ch 106)

Radiated Spurious Emission, Vertical

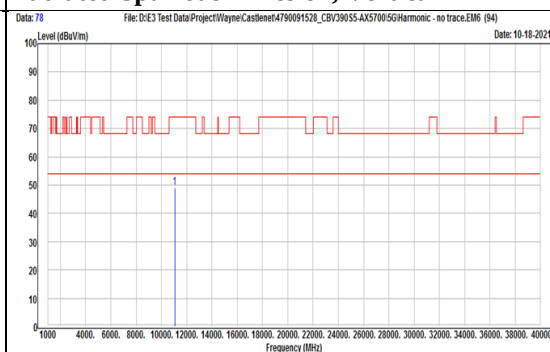


TX, 802.11ax(HE80) (Ch 106)

Band Edge (Peak), Horizontal

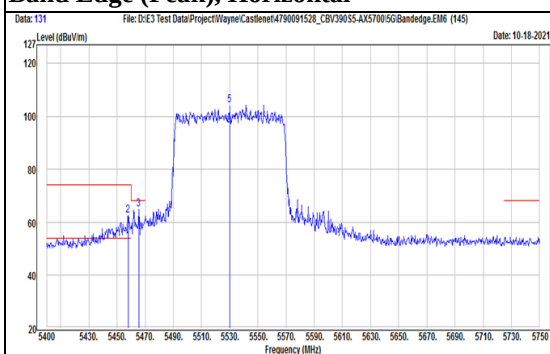

TX, 802.11ax(HE80) (Ch 106)

Band Edge (Peak), Vertical

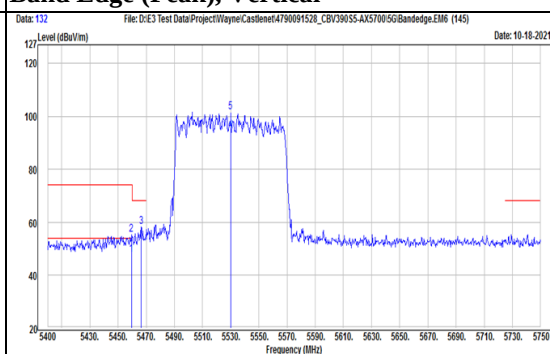

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 134 of 165

報告發行日期 : 2022/1/10

Mode	802.11ax(HE80)	Channel	122
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5445.5	44.51	13.65	58.16	74	-15.84	PK
		5445.5	37	13.65	50.65	54	-3.35	AVG
		5462.3	48.67	13.71	62.38	68.2	-5.82	PK
	@	5610	94.83	14.03	108.86	N/A	N/A	PK
	@	5610	87.35	14.03	101.38	N/A	N/A	AVG
		5726.55	51.43	14.19	65.62	68.2	-2.58	PK
	*	11220	29.88	18.25	48.13	74	-25.87	PK
Vertical		5447.6	43.66	13.66	57.32	74	-16.68	PK
		5447.6	37.05	13.66	50.71	54	-3.29	AVG
		5466.85	42.04	13.72	55.76	68.2	-12.44	PK
	@	5610	92.62	14.03	106.65	N/A	N/A	PK
	@	5610	85.68	14.03	99.71	N/A	N/A	AVG
		5726.2	43.12	14.18	57.3	68.2	-10.9	PK
	*	11220	30.4	18.25	48.65	74	-25.35	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




TX, 802.11ax(HE80) (Ch 122)

Radiated Spurious Emission, Horizontal

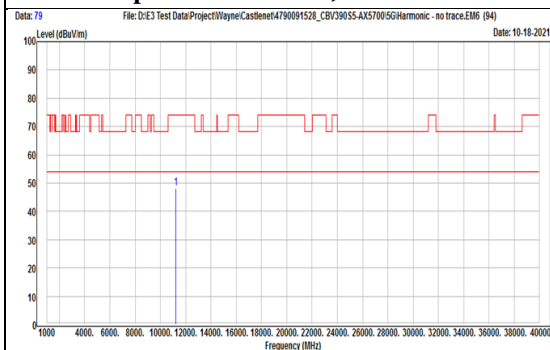


TX, 802.11ax(HE80) (Ch 122)

Radiated Spurious Emission, Vertical

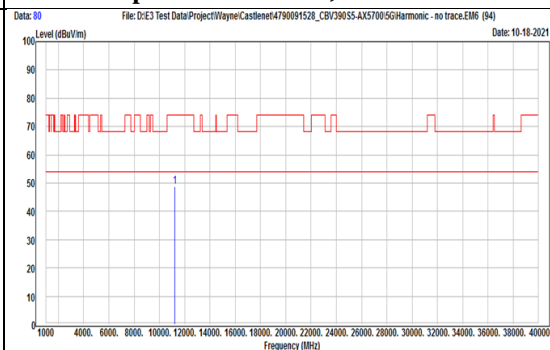


TX, 802.11ax(HE80) (Ch 122)

Band Edge (Peak), Horizontal

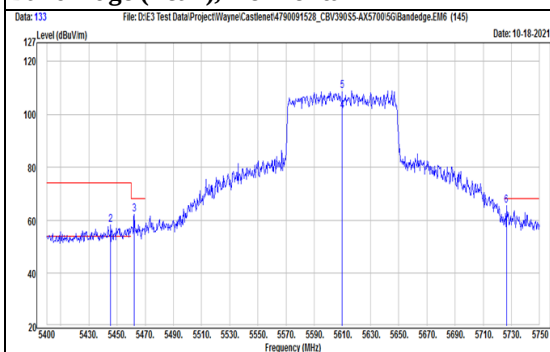

TX, 802.11ax(HE80) (Ch 122)

Band Edge (Peak), Vertical

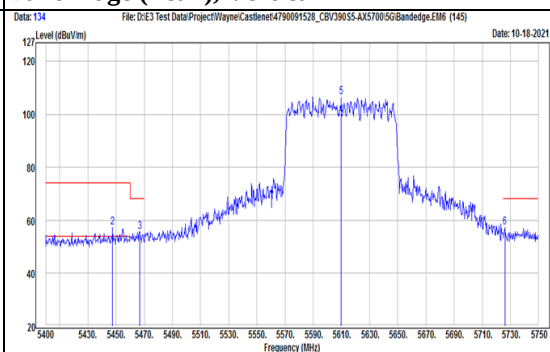

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0
頁碼 : 136 of 165
報告發行日期 : 2022/1/10

Mode	802.11ax(HE80)	Channel	138
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	11380	30	18.67	48.67	74	-25.33	PK
Vertical	*	11380	30.25	18.67	48.92	74	-25.08	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0
頁碼 : 137 of 165
報告發行日期 : 2022/1/10


TX, 802.11ax(HE80) (Ch 138)

Radiated Spurious Emission, Horizontal



TX, 802.11ax(HE80) (Ch 138)

Radiated Spurious Emission, Vertical

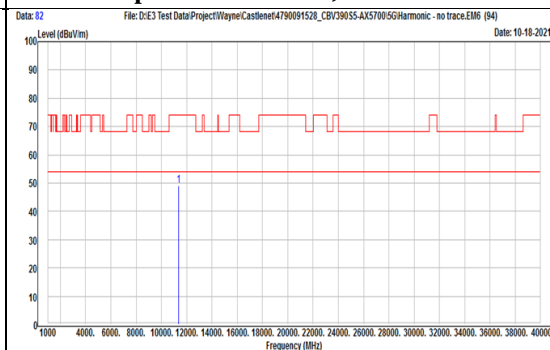

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 138 of 165

報告發行日期 : 2022/1/10

Mode	802.11ax(HE80)	Channel	155
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5647.5	53.28	14.01	67.29	68.2	-0.91	PK
		5699	69.92	14.05	83.97	104.46	-20.49	PK
	@	5775	97.62	14.44	112.06	N/A	N/A	PK
		5876.5	62.36	14.89	77.25	104.09	-26.84	PK
		5928.5	50.97	14.99	65.96	68.2	-2.24	PK
		11550	42.88	18.93	61.81	74	-12.19	PK
		11550	30.15	18.93	49.08	54	-4.92	AVG
Vertical		5648.5	45.91	14	59.91	68.2	-8.29	PK
		5698	62.59	14.05	76.64	103.73	-27.09	PK
	@	5775	96.63	14.44	111.07	N/A	N/A	PK
		5880	53.12	14.91	68.03	101.49	-33.46	PK
		5925	48.33	14.99	63.32	68.2	-4.88	PK
		11550	37.81	18.93	56.74	74	-17.26	PK
		11550	26.24	18.93	45.17	54	-8.83	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




報告編號 : 4790091528-TW-R1-V0

頁碼 : 139 of 165

報告發行日期 : 2022/1/10


TX, 802.11ax(HE80) (Ch 155)

Radiated Spurious Emission, Horizontal

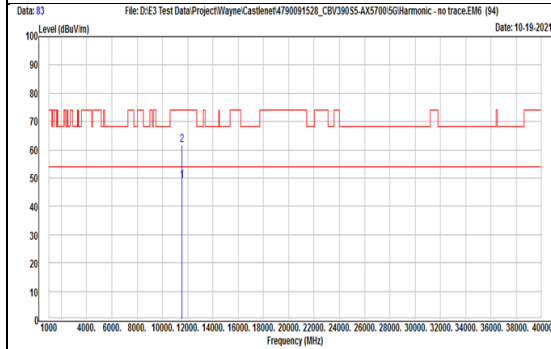


TX, 802.11ax(HE80) (Ch 155)

Radiated Spurious Emission, Vertical

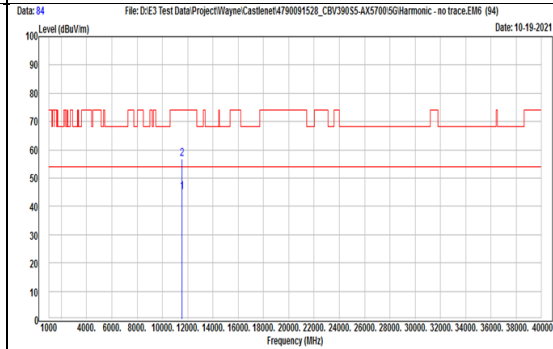


TX, 802.11ax(HE80) (Ch 155)

Band Edge (Peak), Horizontal

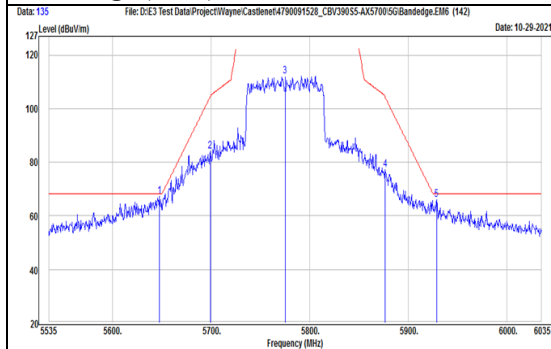

TX, 802.11ax(HE80) (Ch 155)

Band Edge (Peak), Vertical

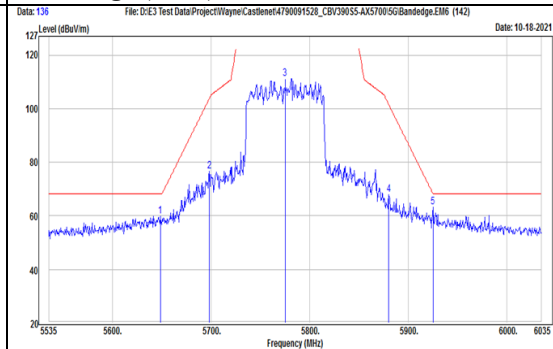

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 140 of 165

報告發行日期 : 2022/1/10

Mode	802.11ax(HE160)	Channel	50
------	-----------------	---------	----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5127.88	53.36	13.43	66.79	74	-7.21	PK
		5147.2	39.44	13.43	52.87	54	-1.13	AVG
	@	5250	89.56	13.24	102.8	N/A	N/A	PK
	@	5250	80.78	13.24	94.02	N/A	N/A	AVG
		5350	39.59	13.26	52.85	54	-1.15	AVG
		5394.68	49.81	13.4	63.21	74	-10.79	PK
	*	10500	30.95	17.72	48.67	68.2	-19.53	PK
Vertical		5138.92	43.46	13.43	56.89	74	-17.11	PK
		5144.44	32.71	13.43	46.14	54	-7.86	AVG
	@	5250	86.64	13.24	99.88	N/A	N/A	PK
	@	5250	77.81	13.24	91.05	N/A	N/A	AVG
		5351.9	31.91	13.26	45.17	54	-8.83	AVG
		5372.6	42.95	13.34	56.29	74	-17.71	PK
	*	10500	31.24	17.72	48.96	68.2	-19.24	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




報告編號 : 4790091528-TW-R1-V0

頁碼 : 141 of 165

報告發行日期 : 2022/1/10


TX, 802.11ax(HE160) (Ch 50)

Radiated Spurious Emission, Horizontal

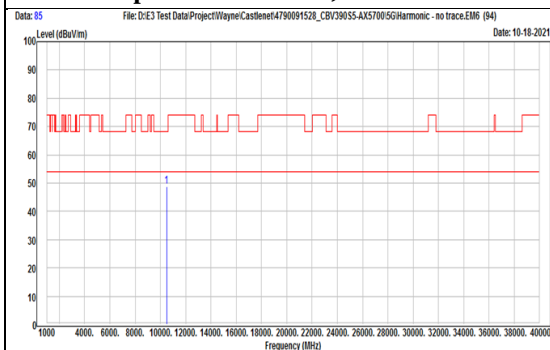


TX, 802.11ax(HE160) (Ch 50)

Radiated Spurious Emission, Vertical

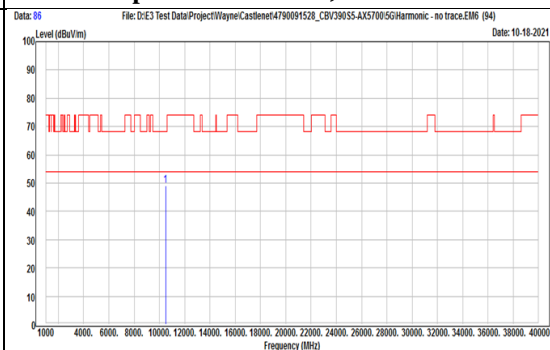


TX, 802.11ax(HE160) (Ch 50)

Band Edge (Average), Horizontal

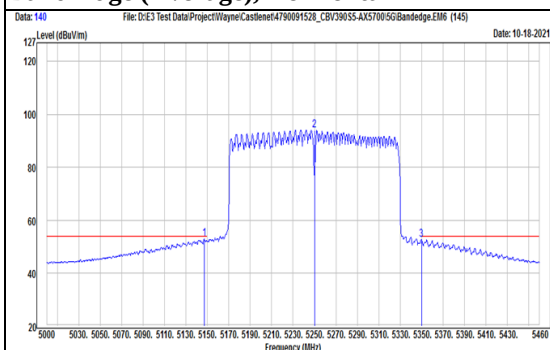


TX, 802.11ax(HE160) (Ch 50)

Band Edge (Average), Vertical

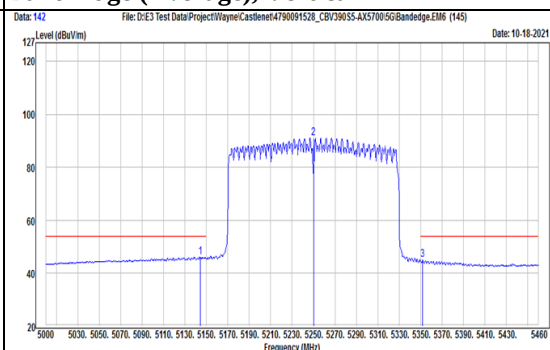


TX, 802.11ax(HE160) (Ch 50)

Band Edge (Peak), Horizontal

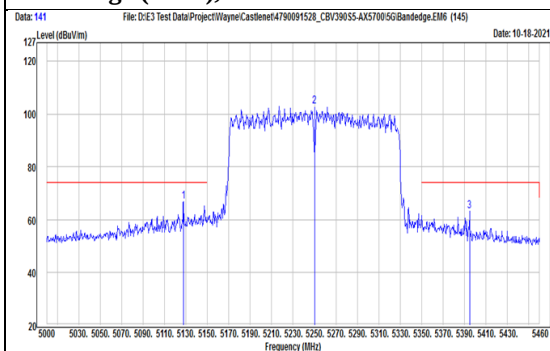

TX, 802.11ax(HE160) (Ch 50)

Band Edge (Peak), Vertical

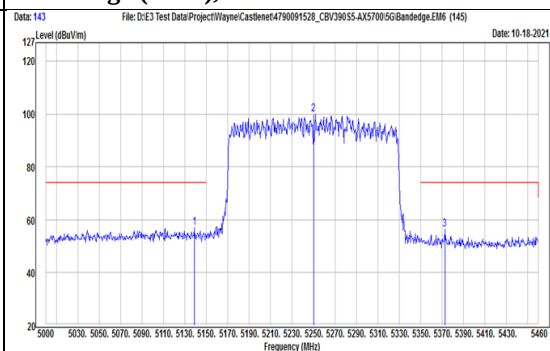

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 142 of 165

報告發行日期 : 2022/1/10

Mode	802.11ax(HE160)	Channel	114
------	-----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		5450.05	49.57	13.67	63.24	74	-10.76	PK
		5450.05	39.84	13.67	53.51	54	-0.49	AVG
		5467.9	47.78	13.74	61.52	68.2	-6.68	PK
	@	5570	87.88	13.95	101.83	N/A	N/A	PK
	@	5570	79.32	13.95	93.27	N/A	N/A	AVG
		5729.7	45.43	14.2	59.63	68.2	-8.57	PK
	*	11140	30.11	18.38	48.49	74	-25.51	PK
Vertical		5447.6	41.23	13.66	54.89	74	-19.11	PK
		5447.6	32.97	13.66	46.63	54	-7.37	AVG
		5469.3	43.1	13.74	56.84	68.2	-11.36	PK
	@	5570	85.94	13.95	99.89	N/A	N/A	PK
	@	5570	76.68	13.95	90.63	N/A	N/A	AVG
		5725.5	41.52	14.18	55.7	68.2	-12.5	PK
	*	11140	30.6	18.38	48.98	74	-25.02	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




報告編號 : 4790091528-TW-R1-V0

頁碼 : 143 of 165

報告發行日期 : 2022/1/10


TX, 802.11ax(HE160) (Ch 114)

Radiated Spurious Emission, Horizontal

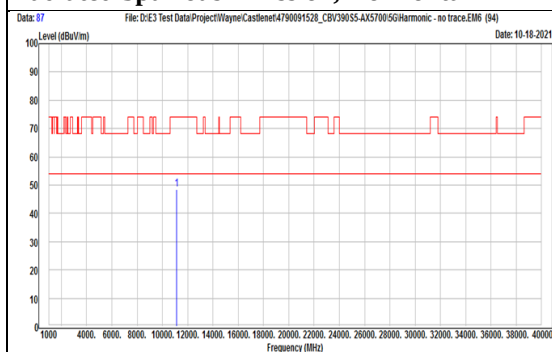


TX, 802.11ax(HE160) (Ch 114)

Radiated Spurious Emission, Vertical

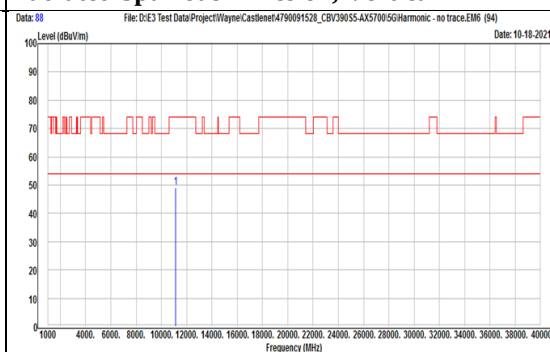


TX, 802.11ax(HE160) (Ch 114)

Band Edge (Peak), Horizontal

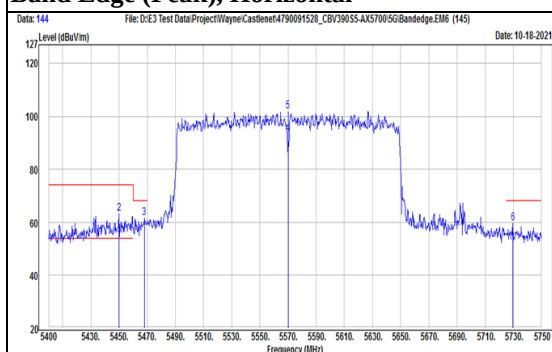

TX, 802.11ax(HE160) (Ch 114)

Band Edge (Peak), Vertical

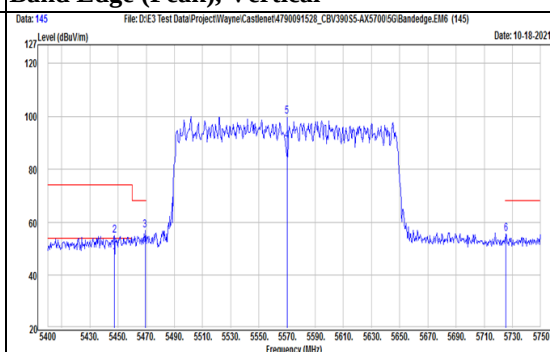

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 144 of 165

報告發行日期 : 2022/1/10

Below 1 GHz

Mode	802.11ax(HE20)	Channel	149
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		131.85	44.14	-13.04	31.1	43.5	-12.4	PK
		288.99	46.57	-10.31	36.26	46	-9.74	PK
		403.45	43.54	-6.89	36.65	46	-9.35	PK
		492.69	47.88	-4.82	43.06	46	-2.94	PK
		589.69	44.07	-2.34	41.73	46	-4.27	PK
		781.75	39.53	0.96	40.49	46	-5.51	PK
Vertical		65.89	45.01	-13.1	31.91	40	-8.09	PK
		124.09	43.04	-13.99	29.05	43.5	-14.45	PK
		289.96	44.59	-10.29	34.3	46	-11.7	PK
		406.36	43.45	-6.85	36.6	46	-9.4	PK
		535.37	46.99	-3.58	43.41	46	-2.59	PK
		763.32	36.48	0.88	37.36	46	-8.64	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




TX, 802.11ax(HE20) (Ch 149)

Radiated Spurious Emission, Horizontal

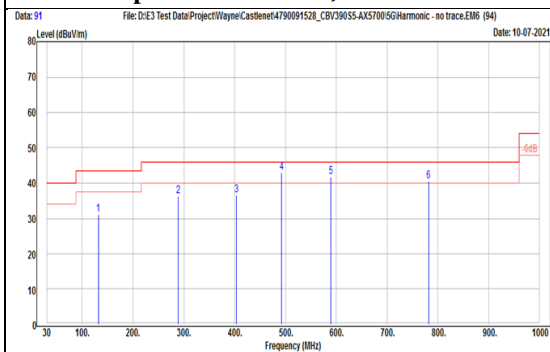

TX, 802.11ax(HE20) (Ch 149)

Radiated Spurious Emission, Vertical

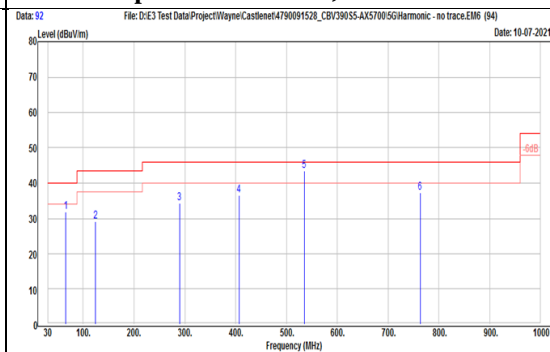

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



同時工作模式:

Above 1 GHz

Mode	Co-location	Channel	WiFi 2.4G 802.11g Ch 6 WiFi 5G 802.11ax20 Ch 149
------	-------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal	*	4874	47.4	2.66	50.06	74	-23.94	PK
	*	11490	33.61	19.02	52.63	74	-21.37	PK
Vertical	*	4874	42.52	2.66	45.18	74	-28.82	PK
	*	11490	30.2	19.02	49.22	74	-24.78	PK


Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan
Telephone :+886-2-7737-3000
Facsimile (FAX) :+886-3-583-7948




TX, Co-location

Radiated Spurious Emission, Horizontal

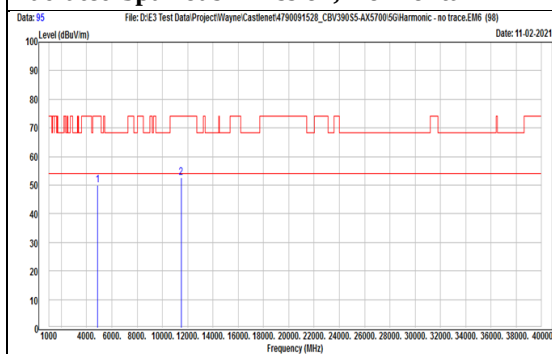

TX, Co-location

Radiated Spurious Emission, Vertical

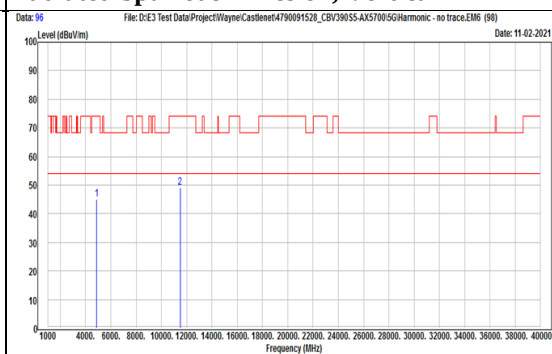

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 148 of 165

報告發行日期 : 2022/1/10

Below 1 GHz

Mode	Co-location	Channel	WiFi 2.4G 802.11g Ch 6 WiFi 5G 802.11ax20 Ch 149
------	-------------	---------	---

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		124.09	43.82	-13.99	29.83	43.5	-13.67	PK
		288.02	44.91	-10.34	34.57	46	-11.43	PK
		405.39	41.51	-6.85	34.66	46	-11.34	PK
		498.51	47.66	-4.79	42.87	46	-3.13	PK
		583.87	44.01	-2.7	41.31	46	-4.69	PK
		787.57	39.4	1.06	40.46	46	-5.54	PK
Vertical		63.95	42.95	-12.62	30.33	40	-9.67	PK
		125.06	42.89	-13.96	28.93	43.5	-14.57	PK
		288.02	43.24	-10.34	32.9	46	-13.1	PK
		400.54	43.25	-6.98	36.27	46	-9.73	PK
		522.76	47.16	-3.94	43.22	46	-2.78	PK
		769.14	35.54	0.97	36.51	46	-9.49	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




TX, Co-location

Radiated Spurious Emission, Horizontal

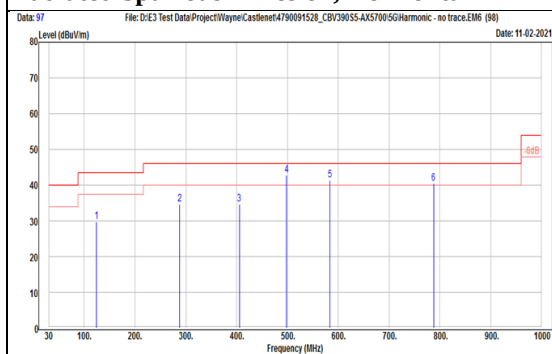

TX, Co-location

Radiated Spurious Emission, Vertical

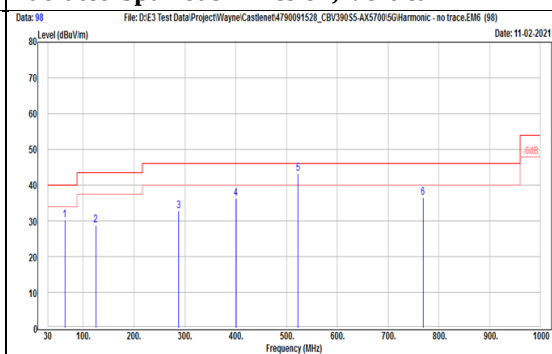

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



接收模式

Above 1 GHz

Mode	802.11ax(HE20)	Channel	149
------	----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		1884	48.6	-6.75	41.85	68.2	-26.35	PK
		2105	47.9	-5.2	42.7	68.2	-25.5	PK
		2802	41.29	-2.85	38.44	74	-35.56	PK
		3822	45.56	-0.38	45.18	74	-28.82	PK
		5114	37.41	3.45	40.86	74	-33.14	PK
		5862	36.93	4.84	41.77	68.2	-26.43	PK
Vertical		2122	42.44	-4.99	37.45	68.2	-30.75	PK
		2904	42.49	-2.59	39.9	68.2	-28.3	PK
		3176	43.35	-1.44	41.91	68.2	-26.29	PK
		4230	41.36	0.55	41.91	74	-32.09	PK
		5131	38.07	3.44	41.51	74	-32.49	PK
		6015	36.72	5.19	41.91	68.2	-26.29	PK

Underwriters Laboratories Taiwan Co., Ltd.


Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan
Telephone :+886-2-7737-3000
Facsimile (FAX) :+886-3-583-7948



報告編號 : 4790091528-TW-R1-V0
頁碼 : 151 of 165
報告發行日期 : 2022/1/10


RX, 802.11ax(HE20) (Ch 149)

Radiated Spurious Emission, Horizontal

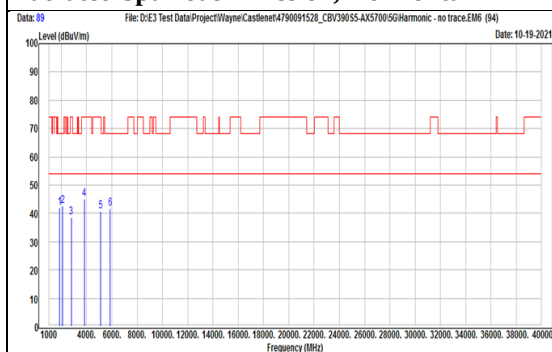

RX, 802.11ax(HE20) (Ch 149)

Radiated Spurious Emission, Vertical

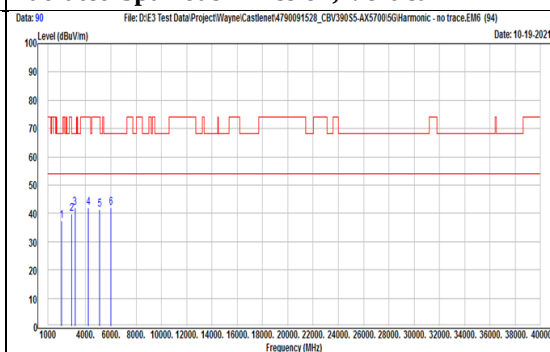

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0

頁碼 : 152 of 165

報告發行日期 : 2022/1/10

Below 1 GHz

Mode	802.11ax(HE20)	Channel	149
------	----------------	---------	-----

Polarization	Notation	Frequency	Reading	Correct	Result	Limit	Margin	Remark
		(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
Horizontal		133.79	42.55	-12.82	29.73	43.5	-13.77	PK
		289.96	46.53	-10.29	36.24	46	-9.76	PK
		405.39	43.15	-6.85	36.3	46	-9.7	PK
		495.6	48.33	-4.81	43.52	46	-2.48	PK
		589.69	44.99	-2.34	42.65	46	-3.35	PK
		787.57	39.49	1.06	40.55	46	-5.45	PK
Vertical		62.98	43.3	-12.44	30.86	40	-9.14	PK
		134.76	42.03	-12.64	29.39	43.5	-14.11	PK
		289.96	44.38	-10.29	34.09	46	-11.91	PK
		412.18	43.99	-6.77	37.22	46	-8.78	PK
		526.64	47.73	-3.81	43.92	46	-2.08	PK
		787.57	35.96	1.06	37.02	46	-8.98	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000


Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




RX, 802.11ax(HE20) (Ch 149)

Radiated Spurious Emission, Horizontal

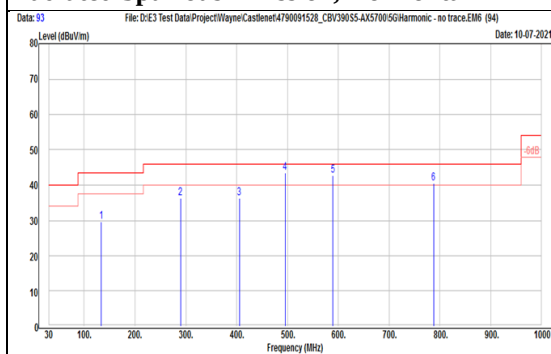

RX, 802.11ax(HE20) (Ch 149)

Radiated Spurious Emission, Vertical

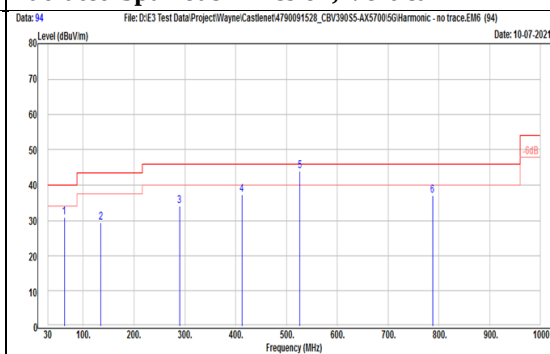

其他不必要之訊號

9 kHz ~ 30 MHz Data

The amplitude of spurious emissions attenuated more than 20 dB below the permissible value is not required to be report.

4.4.6 測試結果判定

依據測試數據結果，符合低功率射頻器材技術規範之要求。

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0

4.5 電源線傳導干擾


4.5.1 適用標準

請見本報告 3.1 節第 (7) 的規定。

4.5.2 測試方法

將待測物置於 0.8 米高的非金屬桌面，使其操作在工作狀態，待測物電源線接至電源線阻抗穩定網路上，從測試接收機記錄頻率由 0.15 MHz 至 30 MHz 之間之電源線傳導放射強度。

4.5.3 測試配置圖

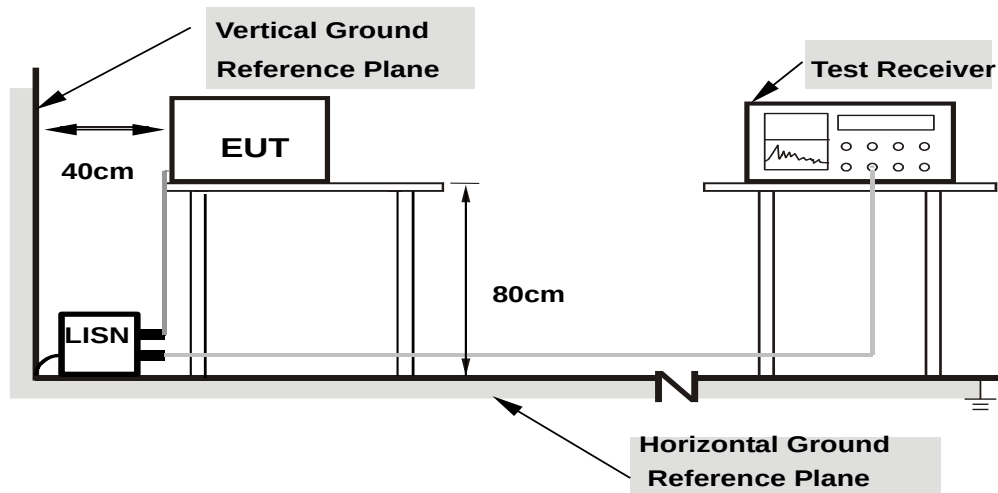

Note: 1.Support units were connected to second LISN.
2.Both of LISNs (AMN) are 80 cm from EUT and at least 80 from other units and other metal planes

For the actual test configuration, please refer to the Appendix IV.



報告編號 : 4790091528-TW-R1-V0

頁碼 : 155 of 165

報告發行日期 : 2022/1/10

4.5.4 電源傳導干擾電壓值之計算

結果值 Result value (dBuV) = 機器讀值 Reading value (dBuV) + 校正因子 Correction Factor (dB)

餘裕度 Margin(dB) = 結果值 Result value (dBuV) - 限制值 Limit value (dBuV)

其中校正因子 Correction Factor (dB)為：

饋線損失+電源阻抗模擬網路損失

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948


Doc No: 17-EM-F0880 / 6.0



4.5.5 測試結果

發射模式

Mode	11g_TX2437	Channel	6
------	------------	---------	---

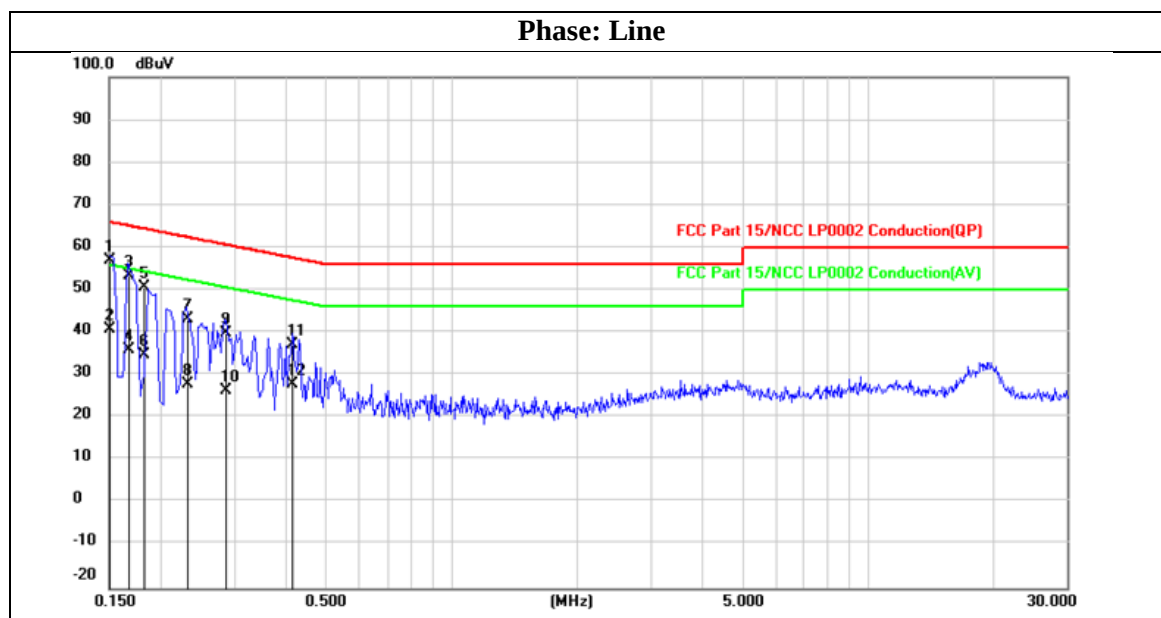

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1504	37.42	19.49	56.91	65.98	-9.07	QP
2	0.1504	21.27	19.49	40.76	55.98	-15.22	AVG
3	0.1672	33.99	19.49	53.48	65.10	-11.62	QP
4	0.1672	16.44	19.49	35.93	55.10	-19.17	AVG
5	0.1822	31.07	19.49	50.56	64.38	-13.82	QP
6	0.1822	15.40	19.49	34.89	54.38	-19.49	AVG
7	0.2320	23.60	19.49	43.09	62.38	-19.29	QP
8	0.2320	8.35	19.49	27.84	52.38	-24.54	AVG
9	0.2862	20.24	19.49	39.73	60.63	-20.90	QP
10	0.2862	6.85	19.49	26.34	50.63	-24.29	AVG
11	0.4130	17.67	19.49	37.16	57.59	-20.43	QP
12	0.4130	8.44	19.49	27.93	47.59	-19.66	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan
Telephone : +886-2-7737-3000
Facsimile (FAX) : +886-3-583-7948




報告編號 : 4790091528-TW-R1-V0

頁碼 : 157 of 165

報告發行日期 : 2022/1/10

Mode 11g_TX2437

Channel 6

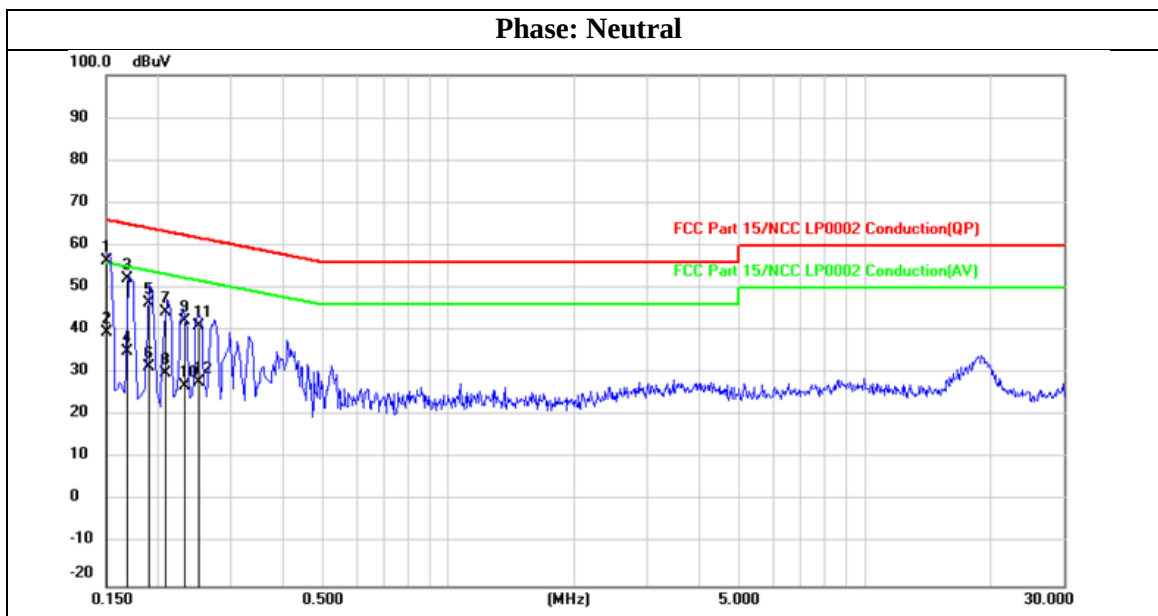

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1511	36.78	19.49	56.27	65.94	-9.67	QP
2	0.1511	20.05	19.49	39.54	55.94	-16.40	AVG
3	0.1680	32.81	19.49	52.30	65.06	-12.76	QP
4	0.1680	15.65	19.49	35.14	55.06	-19.92	AVG
5	0.1904	27.01	19.49	46.50	64.02	-17.52	QP
6	0.1904	12.07	19.49	31.56	54.02	-22.46	AVG
7	0.2077	24.77	19.49	44.26	63.30	-19.04	QP
8	0.2077	10.51	19.49	30.00	53.30	-23.30	AVG
9	0.2316	22.66	19.49	42.15	62.39	-20.24	QP
10	0.2316	7.54	19.49	27.03	52.39	-25.36	AVG
11	0.2516	21.56	19.49	41.05	61.70	-20.65	QP
12	0.2516	8.49	19.49	27.98	51.70	-23.72	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




報告編號 : 4790091528-TW-R1-V0

頁碼 : 158 of 165

報告發行日期 : 2022/1/10

接收模式

Mode	11g_RX2437	Channel	6
------	------------	---------	---

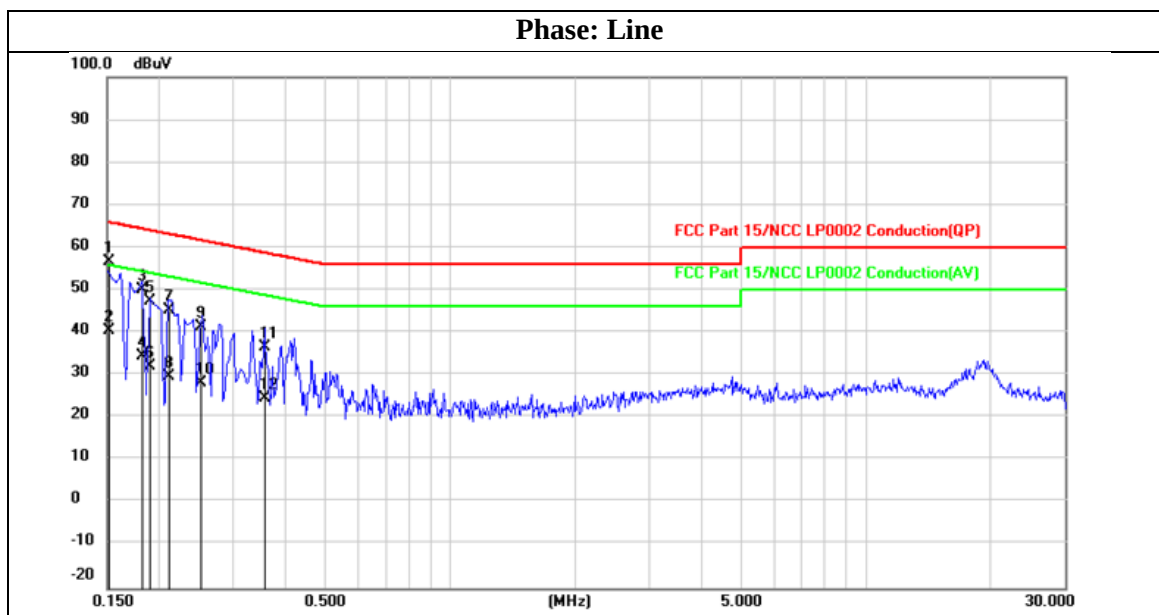

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1521	37.12	19.49	56.61	65.88	-9.27	QP
2	0.1521	20.84	19.49	40.33	55.88	-15.55	AVG
3	0.1814	30.66	19.49	50.15	64.42	-14.27	QP
4	0.1814	15.11	19.49	34.60	54.42	-19.82	AVG
5	0.1894	27.84	19.49	47.33	64.06	-16.73	QP
6	0.1894	12.51	19.49	32.00	54.06	-22.06	AVG
7	0.2114	25.64	19.49	45.13	63.15	-18.02	QP
8	0.2114	10.31	19.49	29.80	53.15	-23.35	AVG
9	0.2513	21.81	19.49	41.30	61.71	-20.41	QP
10	0.2513	8.76	19.49	28.25	51.71	-23.46	AVG
11	0.3604	16.95	19.49	36.44	58.72	-22.28	QP
12	0.3604	5.08	19.49	24.57	48.72	-24.15	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




報告編號 : 4790091528-TW-R1-V0

頁碼 : 159 of 165

報告發行日期 : 2022/1/10

Mode 11g_RX2437

Channel 6

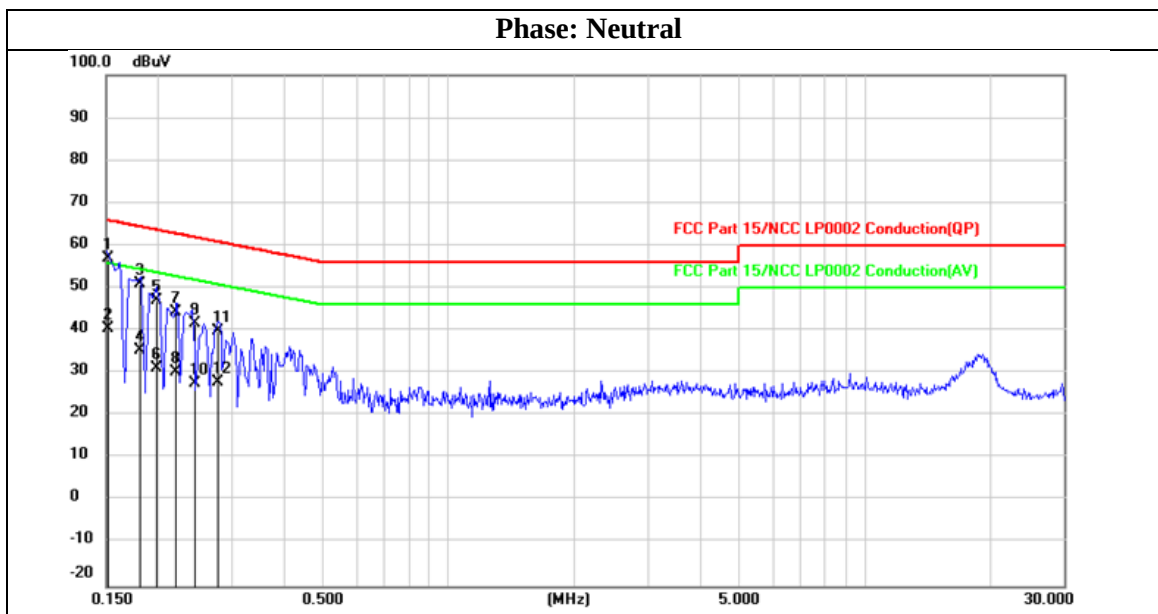

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1515	37.43	19.49	56.92	65.92	-9.00	QP
2	0.1515	20.95	19.49	40.44	55.92	-15.48	AVG
3	0.1799	31.58	19.49	51.07	64.49	-13.42	QP
4	0.1799	15.95	19.49	35.44	54.49	-19.05	AVG
5	0.1971	27.46	19.49	46.95	63.73	-16.78	QP
6	0.1971	11.73	19.49	31.22	53.73	-22.51	AVG
7	0.2215	24.84	19.49	44.33	62.76	-18.43	QP
8	0.2215	10.81	19.49	30.30	52.76	-22.46	AVG
9	0.2442	22.29	19.49	41.78	61.95	-20.17	QP
10	0.2442	8.08	19.49	27.57	51.95	-24.38	AVG
11	0.2767	20.38	19.49	39.87	60.91	-21.04	QP
12	0.2767	8.30	19.49	27.79	50.91	-23.12	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




報告編號 : 4790091528-TW-R1-V0

頁碼 : 160 of 165

報告發行日期 : 2022/1/10

同時工作模式:

Mode	WiFi 2.4G 802.11g WiFi 5G 802.11ax20	Channel	Ch 6 Ch 149
------	---	---------	----------------

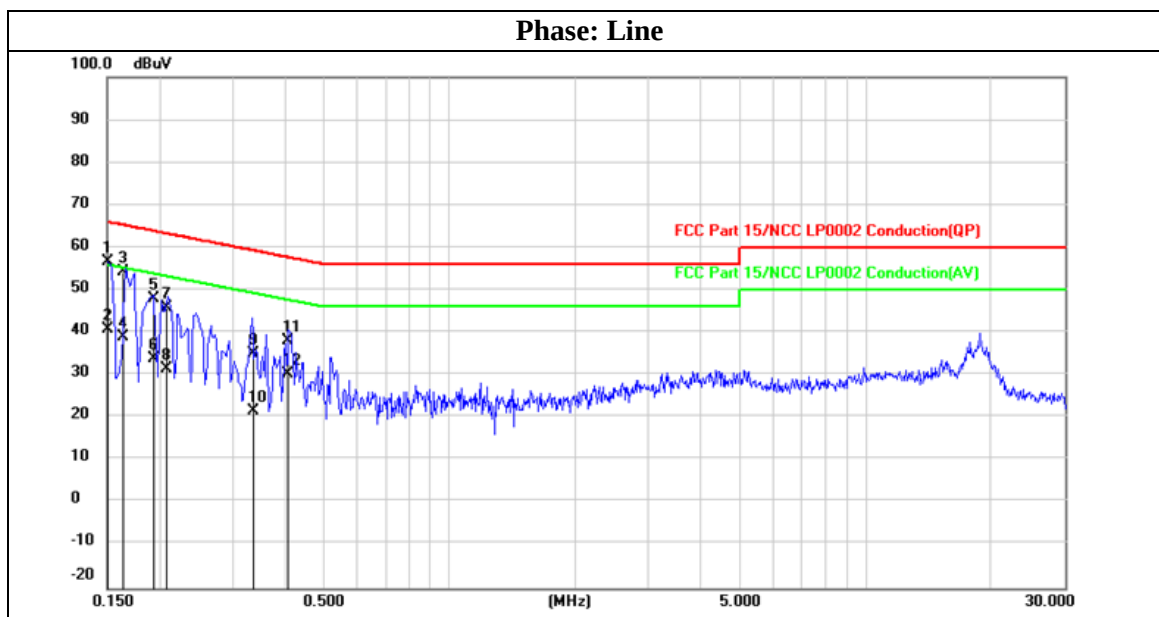

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1511	37.31	19.49	56.80	65.94	-9.14	QP
2	0.1511	21.21	19.49	40.70	55.94	-15.24	AVG
3	0.1632	34.63	19.49	54.12	65.30	-11.18	QP
4	0.1632	19.40	19.49	38.89	55.30	-16.41	AVG
5	0.1931	28.56	19.49	48.05	63.90	-15.85	QP
6	0.1931	14.22	19.49	33.71	53.90	-20.19	AVG
7	0.2079	26.21	19.49	45.70	63.29	-17.59	QP
8	0.2079	11.86	19.49	31.35	53.29	-21.94	AVG
9	0.3364	15.69	19.49	35.18	59.29	-24.11	QP
10	0.3364	1.92	19.49	21.41	49.29	-27.88	AVG
11	0.4086	18.52	19.49	38.01	57.68	-19.67	QP
12	0.4086	10.67	19.49	30.16	47.68	-17.52	AVG

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



Mode	WiFi 2.4G 802.11g WiFi 5G 802.11ax20	Channel	Ch 6 Ch 149
------	---	---------	----------------

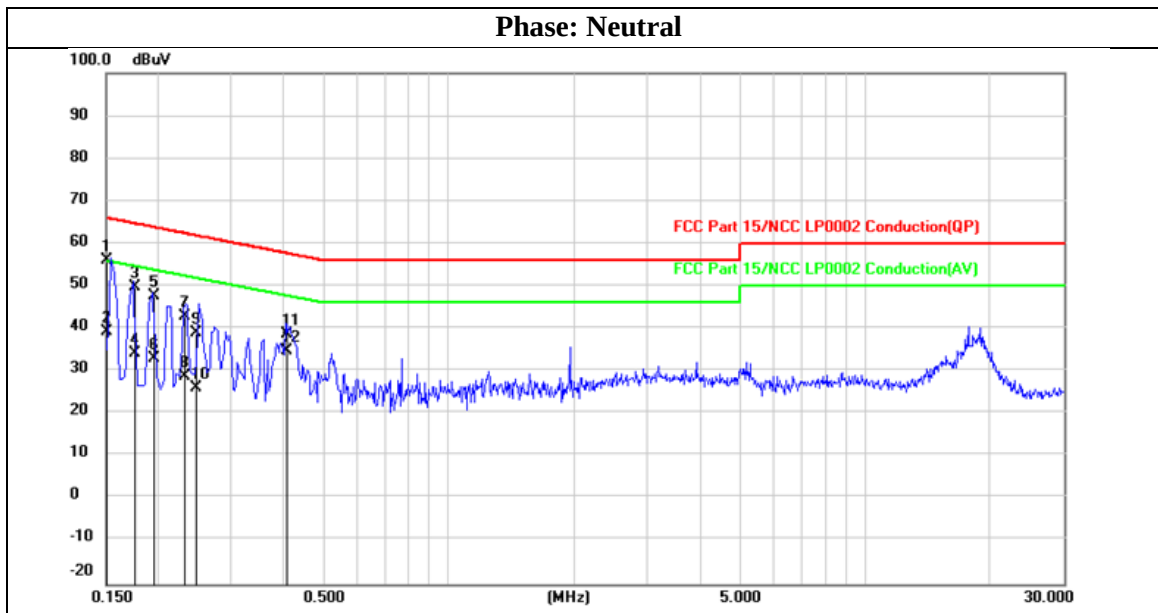

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB)	Result (dBuV)	Limit (dBuV)	Margin (dB)	Remark
1	0.1507	36.62	19.49	56.11	65.96	-9.85	QP
2	0.1507	19.70	19.49	39.19	55.96	-16.77	AVG
3	0.1760	30.34	19.49	49.83	64.67	-14.84	QP
4	0.1760	14.69	19.49	34.18	54.67	-20.49	AVG
5	0.1959	28.10	19.49	47.59	63.78	-16.19	QP
6	0.1959	13.43	19.49	32.92	53.78	-20.86	AVG
7	0.2315	23.35	19.49	42.84	62.40	-19.56	QP
8	0.2315	9.29	19.49	28.78	52.40	-23.62	AVG
9	0.2462	19.47	19.49	38.96	61.88	-22.92	QP
10	0.2462	6.56	19.49	26.05	51.88	-25.83	AVG
11	0.4081	19.10	19.49	38.59	57.69	-19.10	QP
12	0.4081	15.37	19.49	34.86	47.69	-12.83	AVG

4.5.6 測試結果判定

依據測試數據結果，符合低功率射頻器材技術規範之要求。

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0880 / 6.0




報告編號 : 4790091528-TW-R1-V0

頁碼 : 162 of 165

報告發行日期 : 2022/1/10

附錄 I 場強輻射配置照片

Above 1GHz

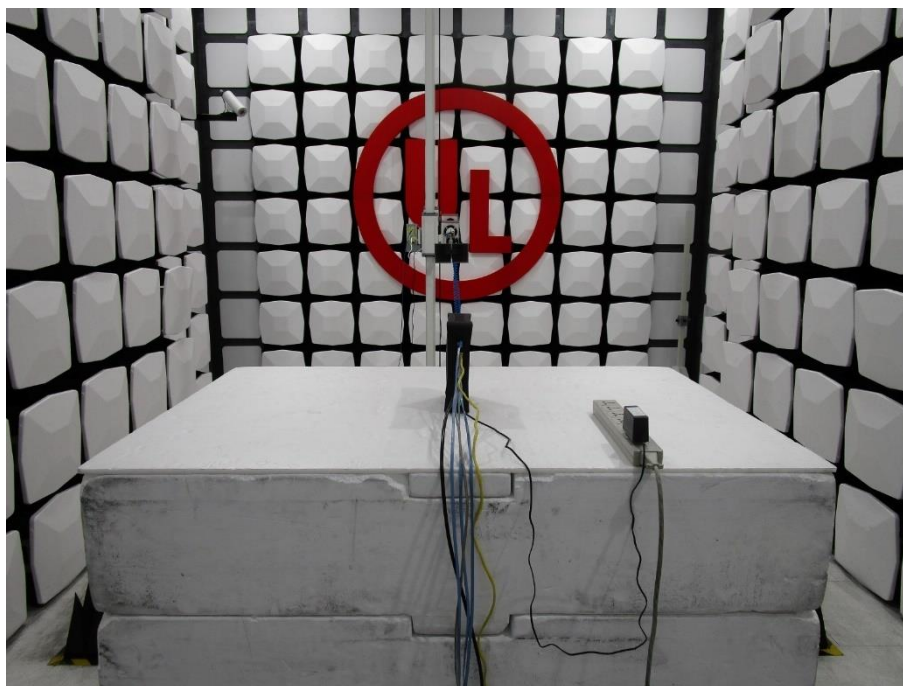

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000



Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0
頁碼 : 163 of 165
報告發行日期 : 2022/1/10

30 MHz ~ 1 GHz

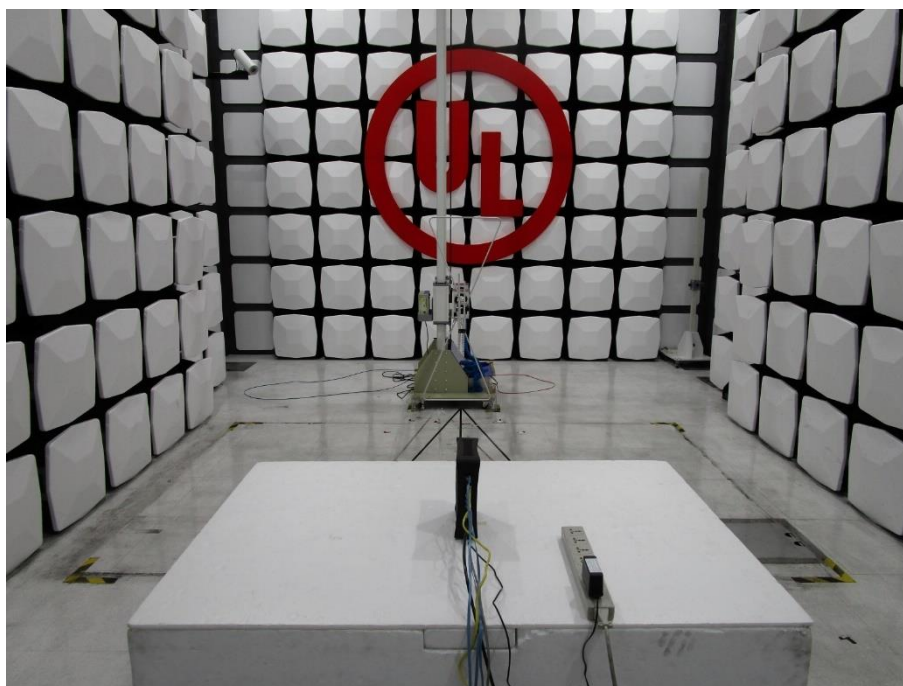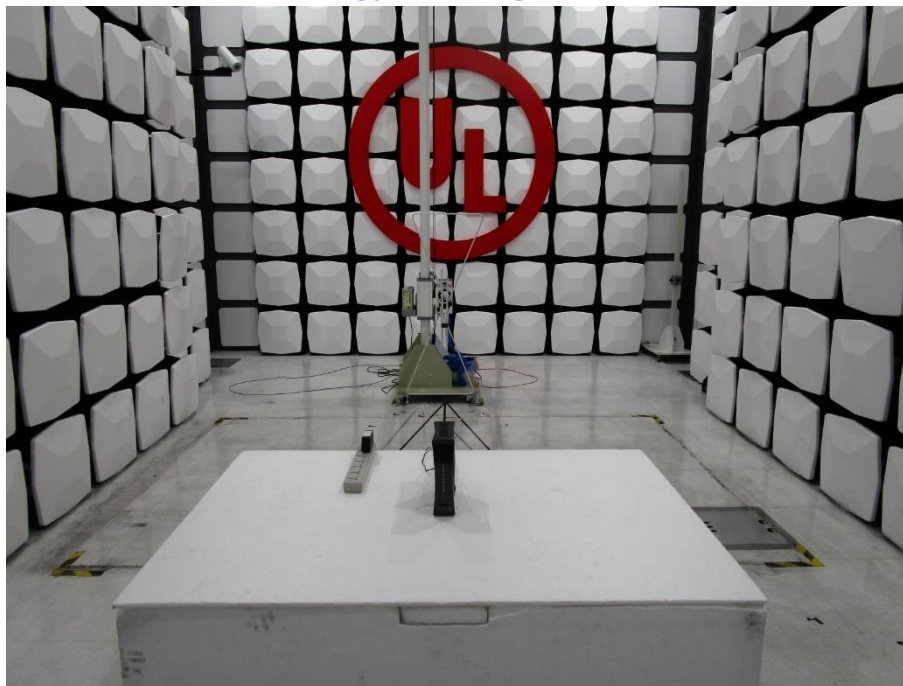

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0





報告編號 : 4790091528-TW-R1-V0

頁碼 : 164 of 165

報告發行日期 : 2022/1/10

9 kHz ~ 30 MHz

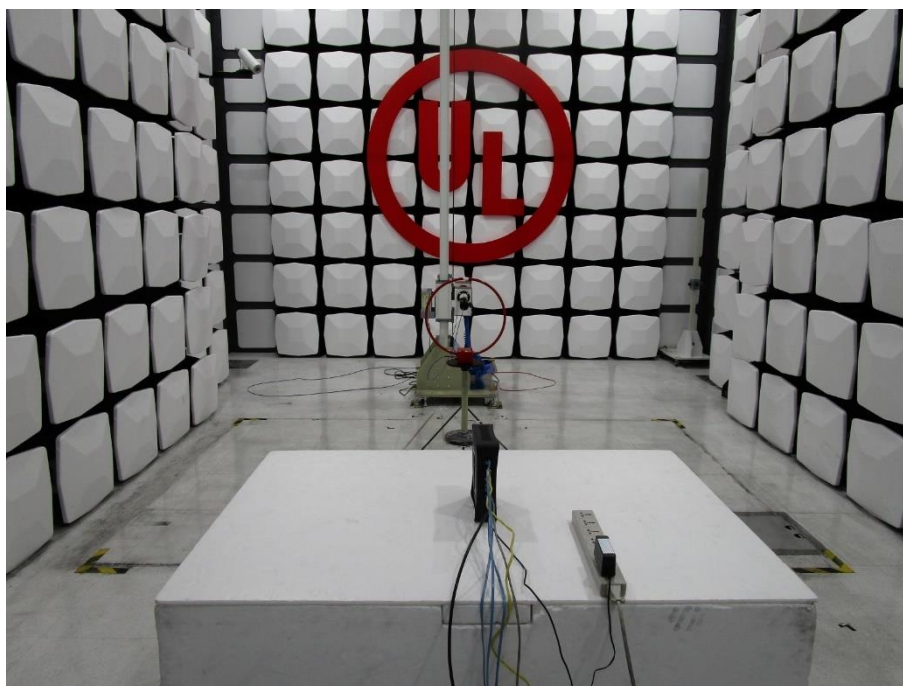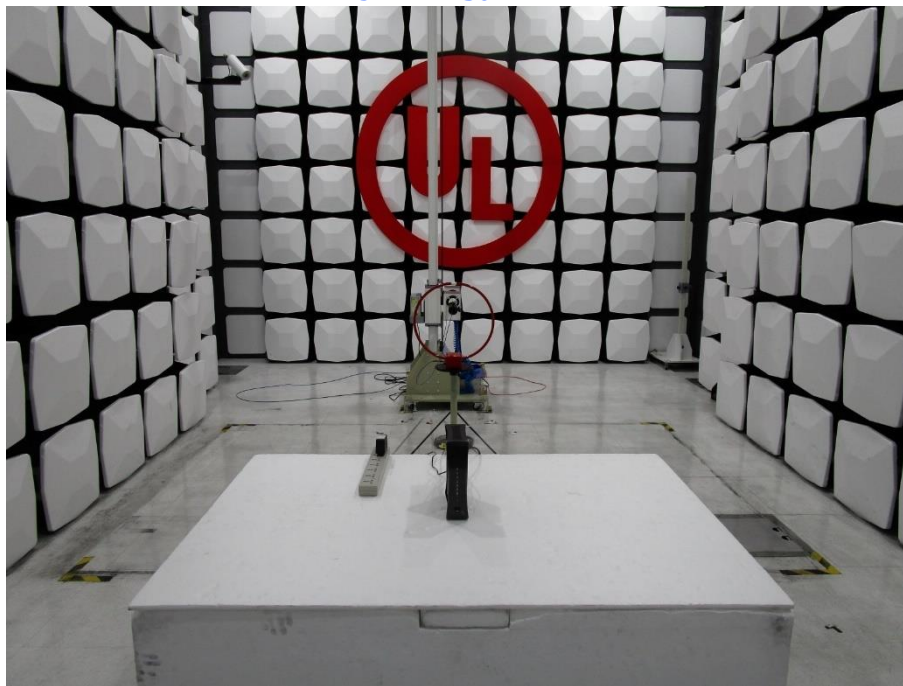

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000


Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0



報告編號 : 4790091528-TW-R1-V0
頁碼 : 165 of 165
報告發行日期 : 2022/1/10

附錄 II 電源線傳導干擾配置照片

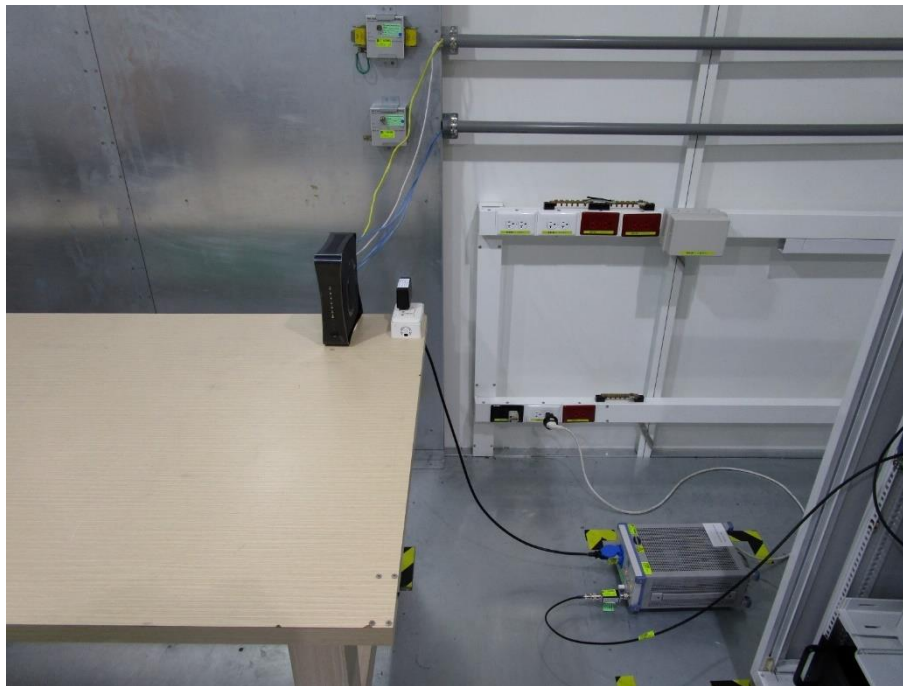

END OF REPORT

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0880 / 6.0