




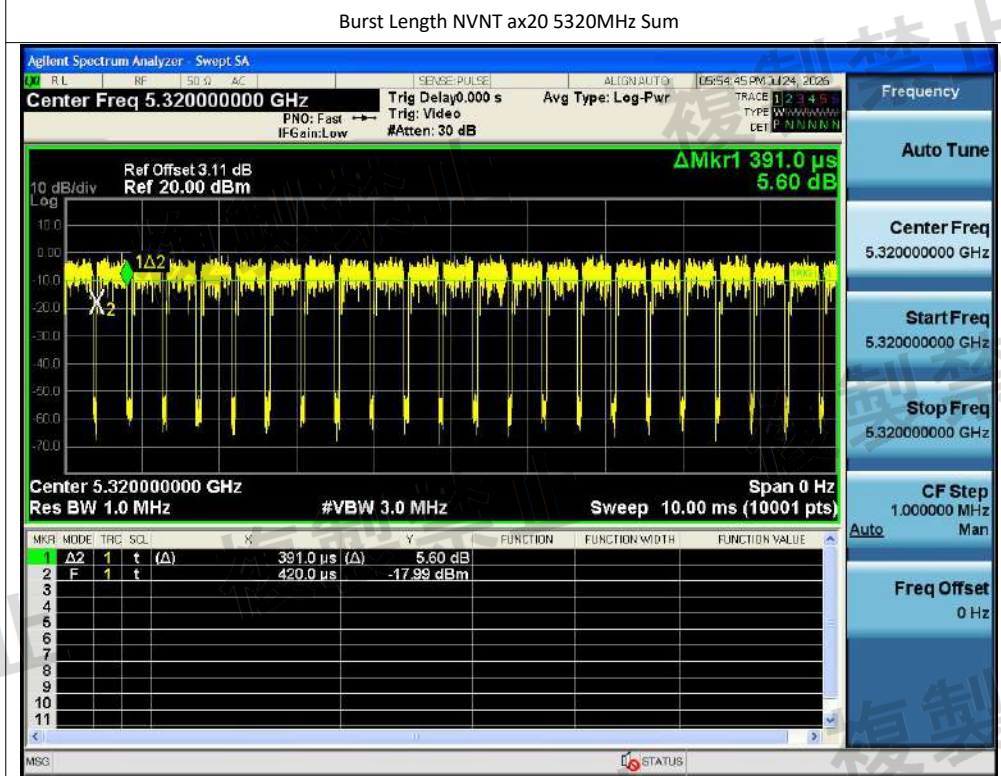
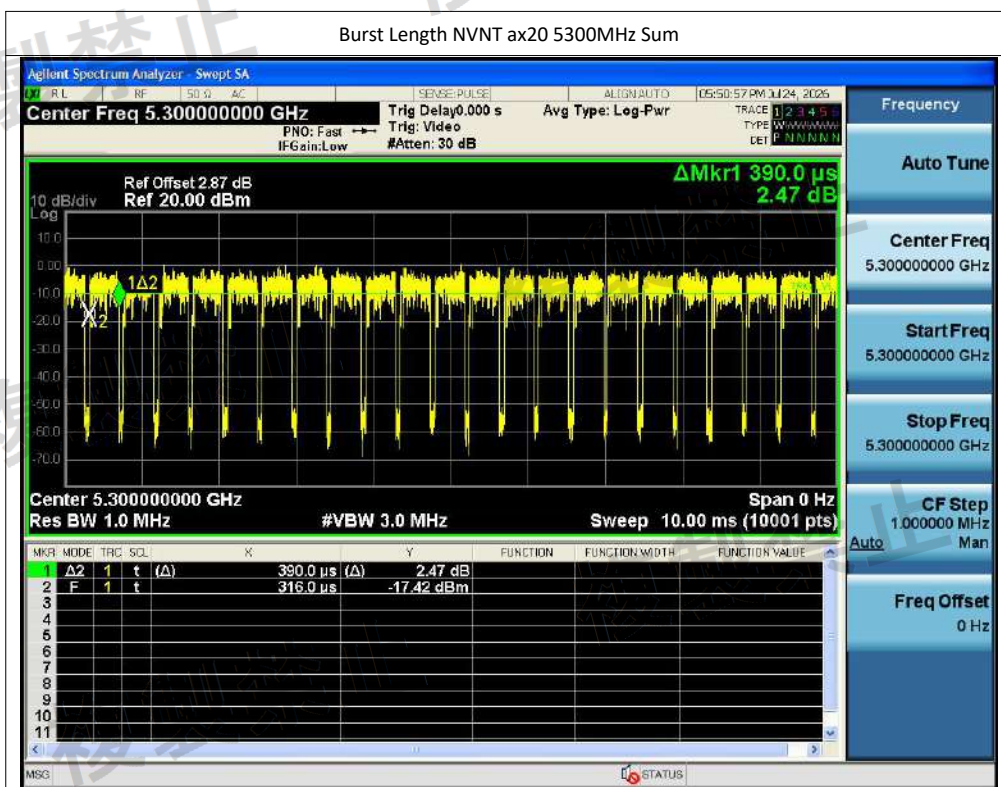
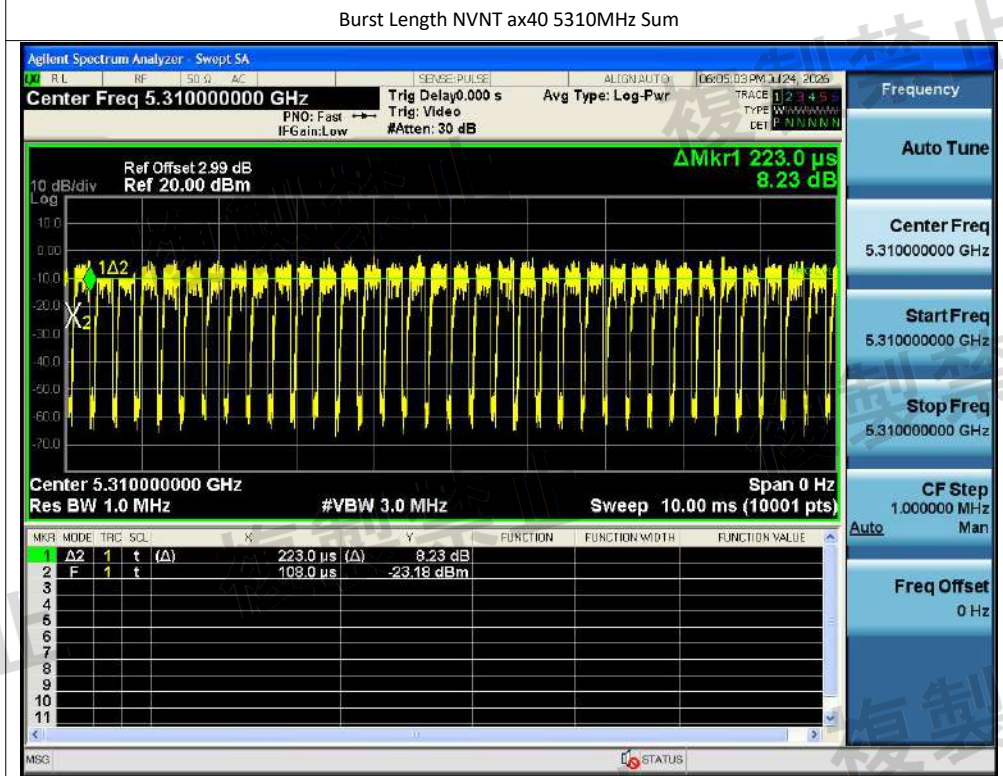
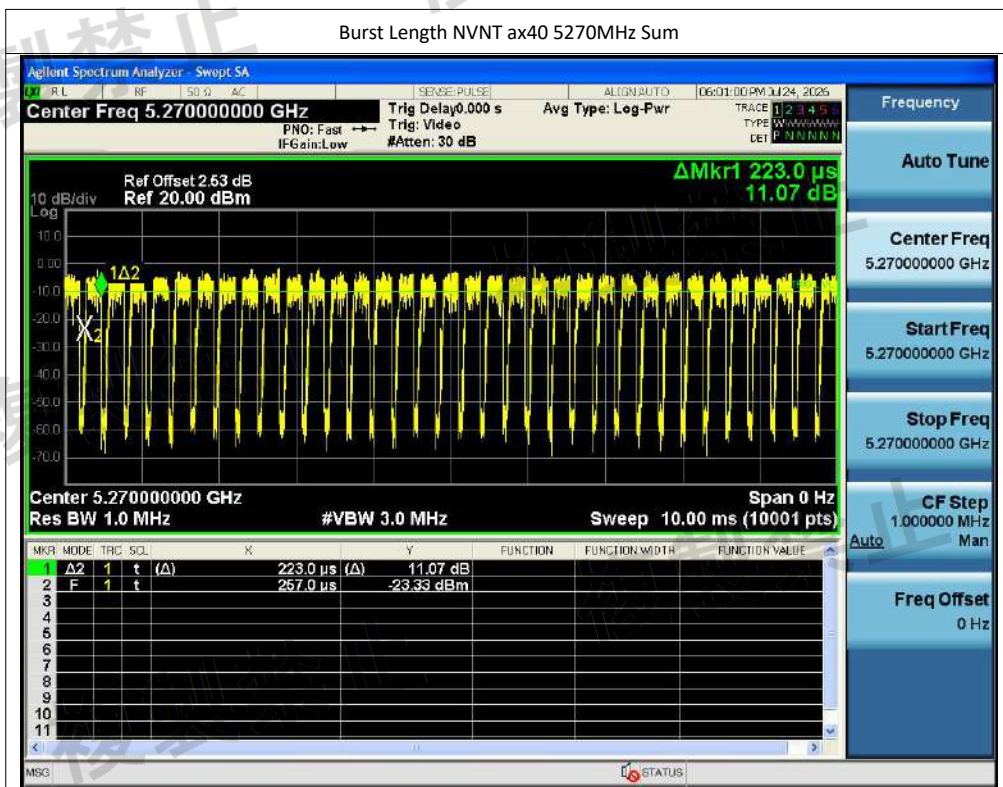
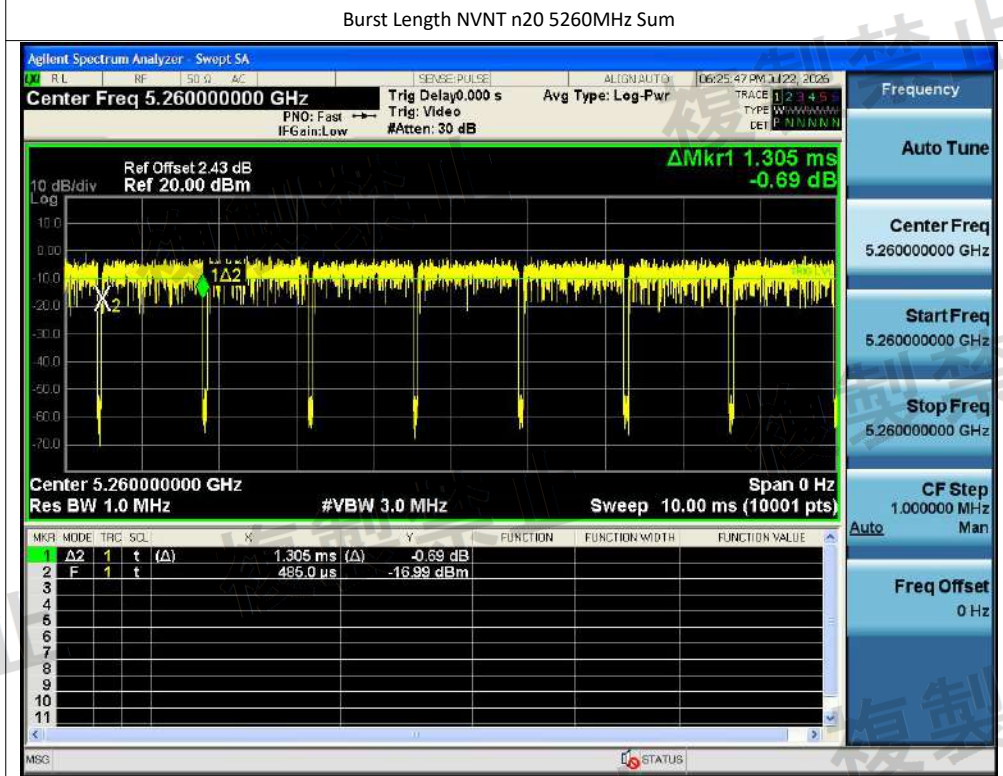


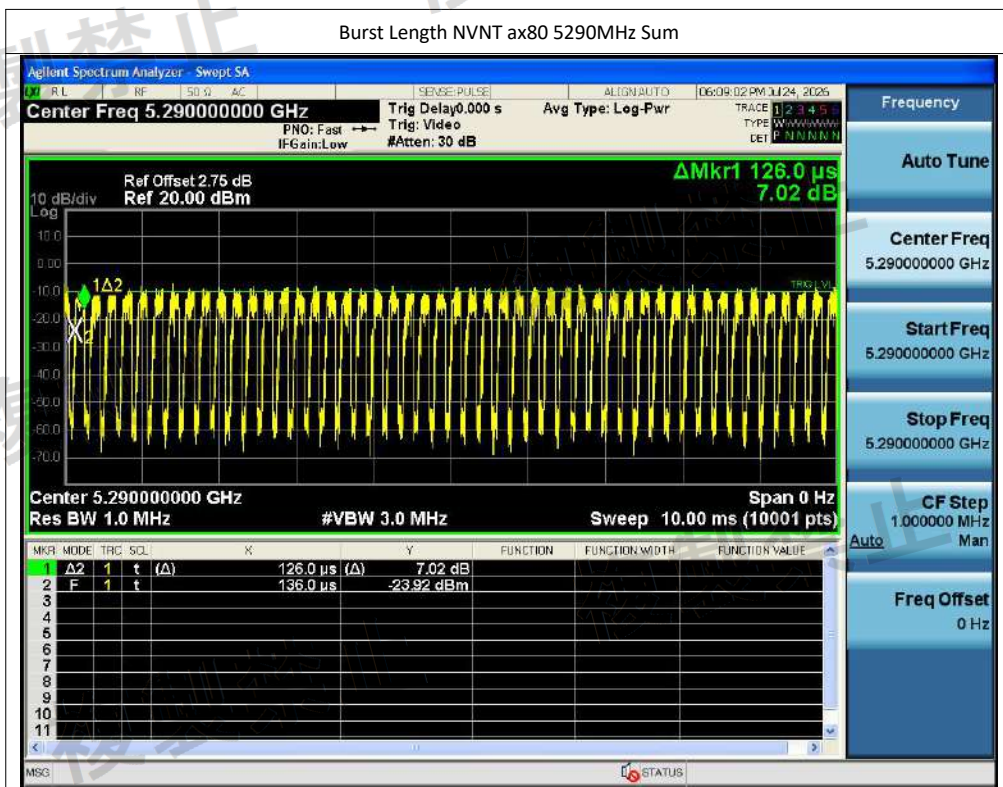

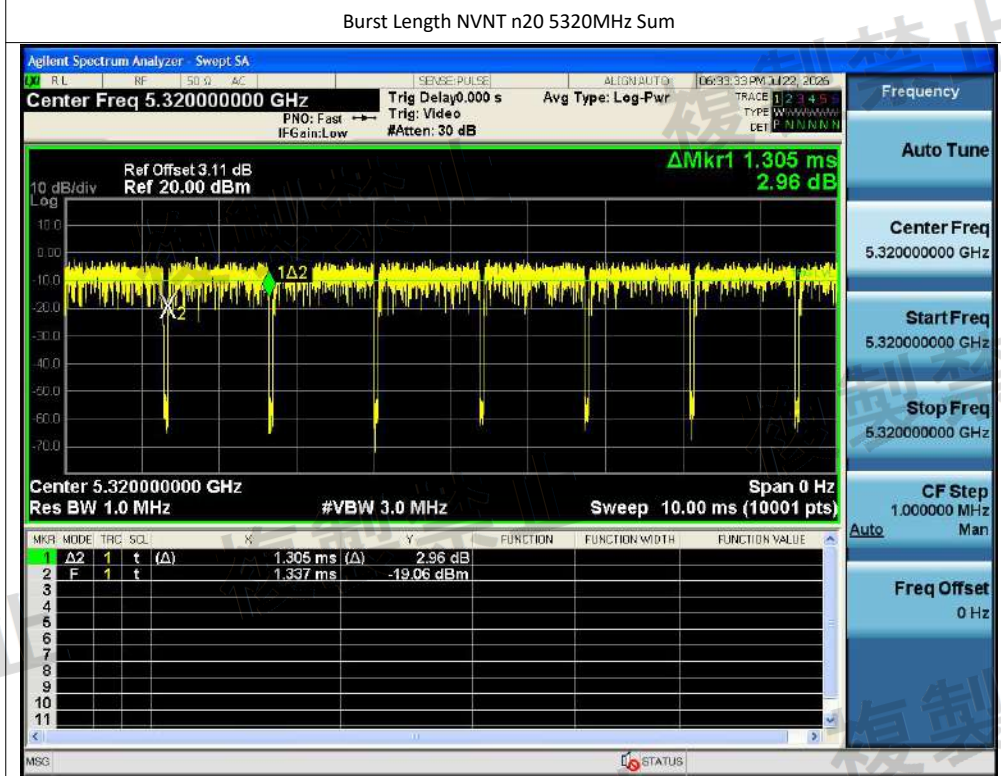

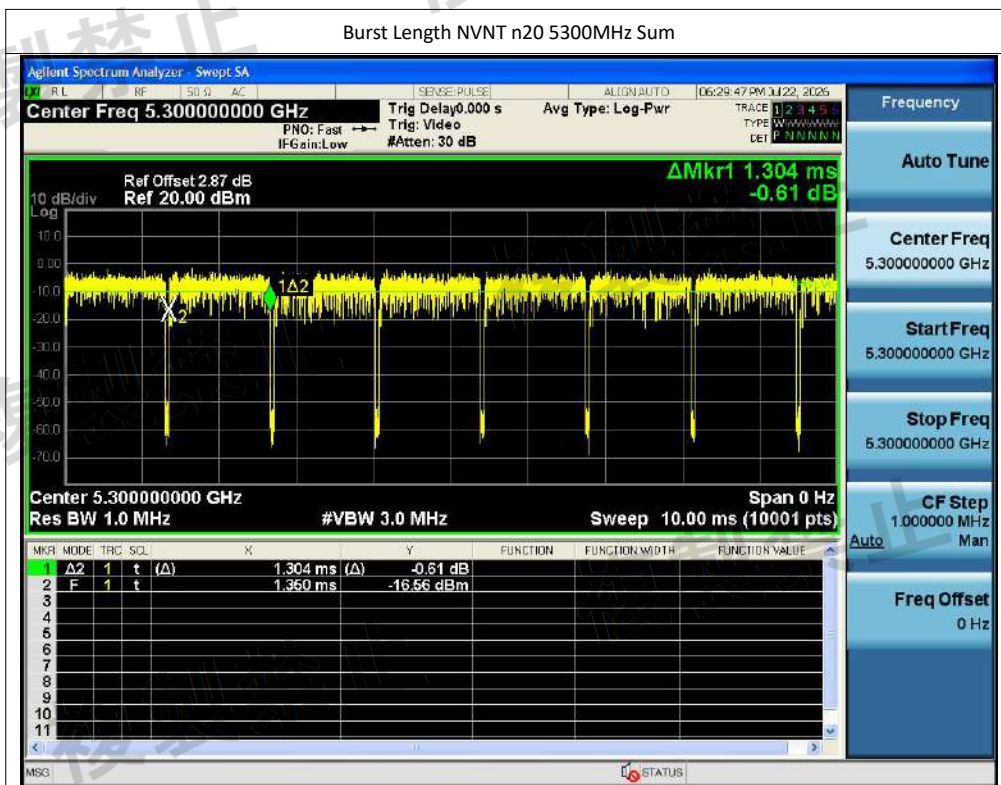

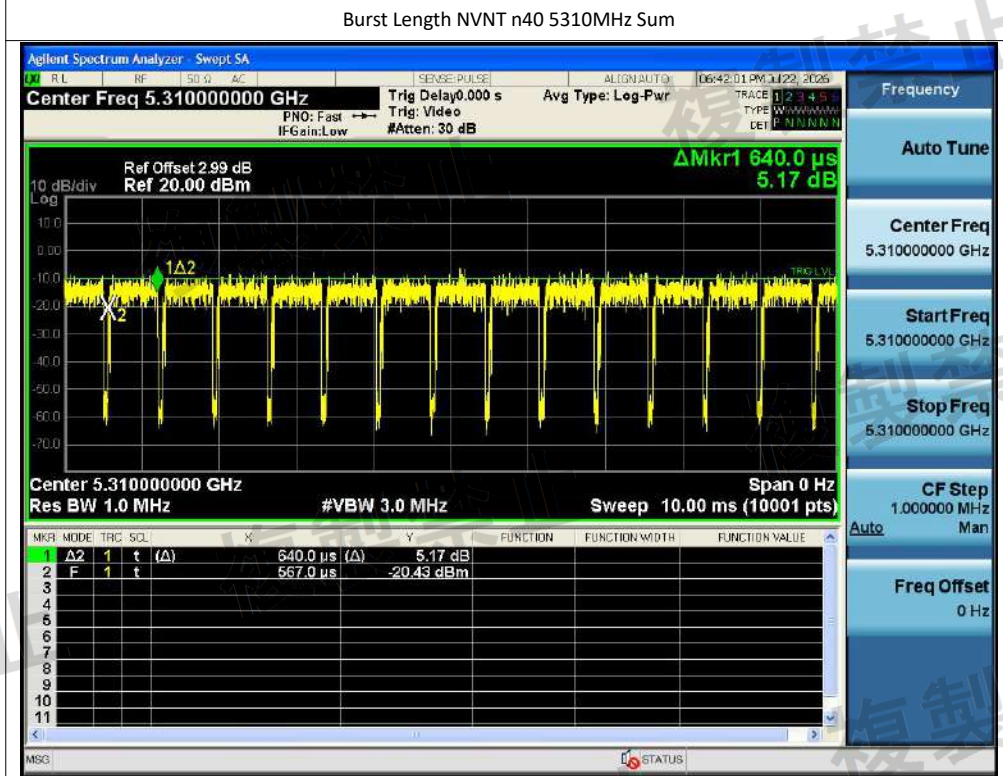

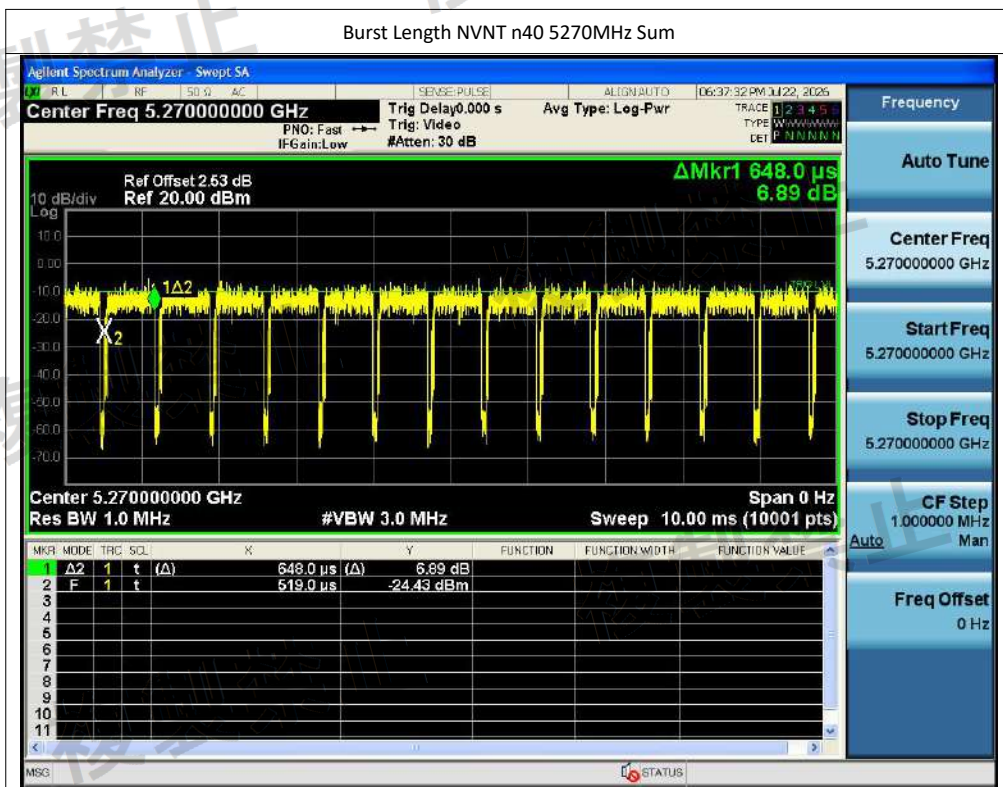

Rx Spurious Emission

Condition	Mode	Frequency (MHz)	Antenna	Range (MHz)	Emission Frequency (MHz)	Max Peak Value (dBm)	Max RMS Value (dBm)	Max Peak Value (nW)	Max RMS Value (nW)	Limit (nW)	Verdict
NVNT	a	5260	Ant1	30-1000	925.31	-81.86	NA	0.0065	NA	4	Pass
NVNT	a	5260	Ant1	1000-26000	25350.00	-59.86	NA	1.0328	NA	20	Pass
NVNT	a	5300	Ant1	30-1000	911.73	-81.41	NA	0.0072	NA	4	Pass
NVNT	a	5300	Ant1	1000-26000	24875.00	-58.99	NA	1.2618	NA	20	Pass
NVNT	a	5320	Ant1	30-1000	853.53	-81.30	NA	0.0074	NA	4	Pass
NVNT	a	5320	Ant1	1000-26000	25200.00	-59.28	NA	1.1803	NA	20	Pass
NVNT	a	5260	Ant2	30-1000	702.21	-80.01	NA	0.01	NA	4	Pass
NVNT	a	5260	Ant2	1000-26000	2325.00	-52.81	NA	5.236	NA	20	Pass
NVNT	a	5300	Ant2	30-1000	936.95	-79.80	NA	0.0105	NA	4	Pass
NVNT	a	5300	Ant2	1000-26000	25325.00	-57.84	NA	1.6444	NA	20	Pass
NVNT	a	5320	Ant2	30-1000	562.53	-80.29	NA	0.0094	NA	4	Pass
NVNT	a	5320	Ant2	1000-26000	25200.00	-58.01	NA	1.5812	NA	20	Pass
NVNT	a	5260	Ant3	30-1000	981.57	-80.44	NA	0.009	NA	4	Pass
NVNT	a	5260	Ant3	1000-26000	24700.00	-58.45	NA	1.4289	NA	20	Pass
NVNT	a	5300	Ant3	30-1000	831.22	-80.54	NA	0.0088	NA	4	Pass
NVNT	a	5300	Ant3	1000-26000	3500.00	-49.58	NA	11.0154	NA	20	Pass
NVNT	a	5320	Ant3	30-1000	949.56	-80.68	NA	0.0086	NA	4	Pass
NVNT	a	5320	Ant3	1000-26000	25325.00	-57.82	NA	1.652	NA	20	Pass
NVNT	ac20	5260	Ant1	30-1000	831.22	-83.03	NA	0.005	NA	4	Pass
NVNT	ac20	5260	Ant1	1000-26000	23550.00	-57.25	NA	1.8836	NA	20	Pass
NVNT	ac20	5260	Ant2	30-1000	745.86	-81.21	NA	0.0076	NA	4	Pass
NVNT	ac20	5260	Ant2	1000-26000	25825.00	-55.76	NA	2.6546	NA	20	Pass
NVNT	ac20	5260	Ant3	30-1000	716.76	-81.03	NA	0.0079	NA	4	Pass
NVNT	ac20	5260	Ant3	1000-26000	23525.00	-55.54	NA	2.7925	NA	20	Pass
NVNT	ac20	5300	Ant1	30-1000	414.12	-83.34	NA	0.0046	NA	4	Pass
NVNT	ac20	5300	Ant1	1000-26000	25750.00	-55.87	NA	2.5882	NA	20	Pass
NVNT	ac20	5300	Ant2	30-1000	863.23	-81.24	NA	0.0075	NA	4	Pass
NVNT	ac20	5300	Ant2	1000-26000	23525.00	-55.20	NA	3.02	NA	20	Pass
NVNT	ac20	5300	Ant3	30-1000	769.14	-82.10	NA	0.0062	NA	4	Pass
NVNT	ac20	5300	Ant3	1000-26000	23600.00	-55.09	NA	3.0974	NA	20	Pass
NVNT	ac20	5320	Ant1	30-1000	805.03	-82.26	NA	0.0059	NA	4	Pass
NVNT	ac20	5320	Ant1	1000-26000	23525.00	-56.17	NA	2.4155	NA	20	Pass
NVNT	ac20	5320	Ant2	30-1000	921.43	-81.39	NA	0.0073	NA	4	Pass
NVNT	ac20	5320	Ant2	1000-26000	25175.00	-55.15	NA	3.0549	NA	20	Pass
NVNT	ac20	5320	Ant3	30-1000	999.03	-81.61	NA	0.0069	NA	4	Pass
NVNT	ac20	5320	Ant3	1000-26000	25275.00	-54.72	NA	3.3729	NA	20	Pass
NVNT	ac40	5270	Ant1	30-1000	736.16	-83.42	NA	0.0045	NA	4	Pass

NVNT	ac40	5270	Ant1	1000-26000	24025.00	-56.82	NA	2.0797	NA	20	Pass
NVNT	ac40	5270	Ant2	30-1000	911.73	-80.46	NA	0.009	NA	4	Pass
NVNT	ac40	5270	Ant2	1000-26000	25150.00	-55.02	NA	3.1477	NA	20	Pass
NVNT	ac40	5270	Ant3	30-1000	808.91	-82.12	NA	0.0061	NA	4	Pass
NVNT	ac40	5270	Ant3	1000-26000	25775.00	-55.74	NA	2.6669	NA	20	Pass
NVNT	ac40	5310	Ant1	30-1000	802.12	-82.66	NA	0.0054	NA	4	Pass
NVNT	ac40	5310	Ant1	1000-26000	25850.00	-56.36	NA	2.3121	NA	20	Pass
NVNT	ac40	5310	Ant2	30-1000	888.45	-81.07	NA	0.0078	NA	4	Pass
NVNT	ac40	5310	Ant2	1000-26000	25750.00	-55.30	NA	2.9512	NA	20	Pass
NVNT	ac40	5310	Ant3	30-1000	946.65	-81.19	NA	0.0076	NA	4	Pass
NVNT	ac40	5310	Ant3	1000-26000	3500.00	-53.75	NA	4.217	NA	20	Pass
NVNT	ac80	5290	Ant1	30-1000	765.26	-83.21	NA	0.0048	NA	4	Pass
NVNT	ac80	5290	Ant1	1000-26000	24150.00	-56.89	NA	2.0464	NA	20	Pass
NVNT	ac80	5290	Ant2	30-1000	935.01	-80.80	NA	0.0083	NA	4	Pass
NVNT	ac80	5290	Ant2	1000-26000	23900.00	-55.57	NA	2.7733	NA	20	Pass
NVNT	ac80	5290	Ant3	30-1000	221.09	-81.69	NA	0.0068	NA	4	Pass
NVNT	ac80	5290	Ant3	1000-26000	23700.00	-55.77	NA	2.6485	NA	20	Pass
NVNT	ax20	5260	Ant1	30-1000	641.10	-83.24	NA	0.0047	NA	4	Pass
NVNT	ax20	5260	Ant1	1000-26000	23925.00	-57.26	NA	1.8793	NA	20	Pass
NVNT	ax20	5260	Ant2	30-1000	954.41	-81.56	NA	0.007	NA	4	Pass
NVNT	ax20	5260	Ant2	1000-26000	25775.00	-55.41	NA	2.8774	NA	20	Pass
NVNT	ax20	5260	Ant3	30-1000	794.36	-81.11	NA	0.0077	NA	4	Pass
NVNT	ax20	5260	Ant3	1000-26000	25750.00	-55.46	NA	2.8445	NA	20	Pass
NVNT	ax20	5300	Ant1	30-1000	747.80	-82.65	NA	0.0054	NA	4	Pass
NVNT	ax20	5300	Ant1	1000-26000	24550.00	-56.85	NA	2.0654	NA	20	Pass
NVNT	ax20	5300	Ant2	30-1000	886.51	-81.27	NA	0.0075	NA	4	Pass
NVNT	ax20	5300	Ant2	1000-26000	25800.00	-55.36	NA	2.9107	NA	20	Pass
NVNT	ax20	5300	Ant3	30-1000	822.49	-82.16	NA	0.0061	NA	4	Pass
NVNT	ax20	5300	Ant3	1000-26000	23525.00	-55.47	NA	2.8379	NA	20	Pass
NVNT	ax20	5320	Ant1	30-1000	923.37	-82.07	NA	0.0062	NA	4	Pass
NVNT	ax20	5320	Ant1	1000-26000	23575.00	-55.89	NA	2.5763	NA	20	Pass
NVNT	ax20	5320	Ant2	30-1000	914.64	-80.86	NA	0.0082	NA	4	Pass
NVNT	ax20	5320	Ant2	1000-26000	24425.00	-54.59	NA	3.4754	NA	20	Pass
NVNT	ax20	5320	Ant3	30-1000	964.11	-81.34	NA	0.0073	NA	4	Pass
NVNT	ax20	5320	Ant3	1000-26000	24025.00	-55.31	NA	2.9444	NA	20	Pass
NVNT	ax40	5270	Ant1	30-1000	716.76	-82.74	NA	0.0053	NA	4	Pass
NVNT	ax40	5270	Ant1	1000-26000	25225.00	-56.89	NA	2.0464	NA	20	Pass
NVNT	ax40	5270	Ant2	30-1000	913.67	-80.88	NA	0.0082	NA	4	Pass
NVNT	ax40	5270	Ant2	1000-26000	23550.00	-54.11	NA	3.8815	NA	20	Pass
NVNT	ax40	5270	Ant3	30-1000	967.02	-81.09	NA	0.0078	NA	4	Pass
NVNT	ax40	5270	Ant3	1000-26000	25775.00	-56.09	NA	2.4604	NA	20	Pass
NVNT	ax40	5310	Ant1	30-1000	926.28	-82.01	NA	0.0063	NA	4	Pass

NVNT	ax40	5310	Ant1	1000-26000	23875.00	-56.49	NA	2.2439	NA	20	Pass
NVNT	ax40	5310	Ant2	30-1000	750.71	-81.65	NA	0.0068	NA	4	Pass
NVNT	ax40	5310	Ant2	1000-26000	25250.00	-54.51	NA	3.54	NA	20	Pass
NVNT	ax40	5310	Ant3	30-1000	908.82	-80.56	NA	0.0088	NA	4	Pass
NVNT	ax40	5310	Ant3	1000-26000	23600.00	-55.70	NA	2.6915	NA	20	Pass
NVNT	ax80	5290	Ant1	30-1000	709.97	-82.99	NA	0.005	NA	4	Pass
NVNT	ax80	5290	Ant1	1000-26000	23875.00	-57.27	NA	1.875	NA	20	Pass
NVNT	ax80	5290	Ant2	30-1000	820.55	-81.03	NA	0.0079	NA	4	Pass
NVNT	ax80	5290	Ant2	1000-26000	25775.00	-55.11	NA	3.0832	NA	20	Pass
NVNT	ax80	5290	Ant3	30-1000	850.62	-81.26	NA	0.0075	NA	4	Pass
NVNT	ax80	5290	Ant3	1000-26000	25650.00	-55.82	NA	2.6182	NA	20	Pass
NVNT	n20	5260	Ant1	30-1000	68.80	-82.20	NA	0.006	NA	4	Pass
NVNT	n20	5260	Ant1	1000-26000	25800.00	-59.33	NA	1.1668	NA	20	Pass
NVNT	n20	5260	Ant2	30-1000	874.87	-79.93	NA	0.0102	NA	4	Pass
NVNT	n20	5260	Ant2	1000-26000	24675.00	-58.04	NA	1.5704	NA	20	Pass
NVNT	n20	5260	Ant3	30-1000	889.42	-80.47	NA	0.009	NA	4	Pass
NVNT	n20	5260	Ant3	1000-26000	25350.00	-58.33	NA	1.4689	NA	20	Pass
NVNT	n20	5300	Ant1	30-1000	942.77	-82.49	NA	0.0056	NA	4	Pass
NVNT	n20	5300	Ant1	1000-26000	23600.00	-56.65	NA	2.1627	NA	20	Pass
NVNT	n20	5300	Ant2	30-1000	779.81	-81.43	NA	0.0072	NA	4	Pass
NVNT	n20	5300	Ant2	1000-26000	23525.00	-55.20	NA	3.02	NA	20	Pass
NVNT	n20	5300	Ant3	30-1000	861.29	-81.55	NA	0.007	NA	4	Pass
NVNT	n20	5300	Ant3	1000-26000	23975.00	-55.27	NA	2.9717	NA	20	Pass
NVNT	n20	5320	Ant1	30-1000	799.21	-82.58	NA	0.0055	NA	4	Pass
NVNT	n20	5320	Ant1	1000-26000	23625.00	-56.24	NA	2.3768	NA	20	Pass
NVNT	n20	5320	Ant2	30-1000	910.76	-80.74	NA	0.0084	NA	4	Pass
NVNT	n20	5320	Ant2	1000-26000	23600.00	-55.49	NA	2.8249	NA	20	Pass
NVNT	n20	5320	Ant3	30-1000	815.70	-80.74	NA	0.0084	NA	4	Pass
NVNT	n20	5320	Ant3	1000-26000	25750.00	-55.16	NA	3.0479	NA	20	Pass
NVNT	n40	5270	Ant1	30-1000	719.67	-83.69	NA	0.0043	NA	4	Pass
NVNT	n40	5270	Ant1	1000-26000	25200.00	-56.03	NA	2.4946	NA	20	Pass
NVNT	n40	5270	Ant2	30-1000	978.66	-80.54	NA	0.0088	NA	4	Pass
NVNT	n40	5270	Ant2	1000-26000	24650.00	-55.14	NA	3.062	NA	20	Pass
NVNT	n40	5270	Ant3	30-1000	819.58	-81.21	NA	0.0076	NA	4	Pass
NVNT	n40	5270	Ant3	1000-26000	23825.00	-55.53	NA	2.799	NA	20	Pass
NVNT	n40	5310	Ant1	30-1000	794.36	-82.21	NA	0.006	NA	4	Pass
NVNT	n40	5310	Ant1	1000-26000	25225.00	-55.74	NA	2.6669	NA	20	Pass
NVNT	n40	5310	Ant2	30-1000	875.84	-80.65	NA	0.0086	NA	4	Pass
NVNT	n40	5310	Ant2	1000-26000	25675.00	-55.45	NA	2.851	NA	20	Pass
NVNT	n40	5310	Ant3	30-1000	934.04	-81.86	NA	0.0065	NA	4	Pass
NVNT	n40	5310	Ant3	1000-26000	23700.00	-54.83	NA	3.2885	NA	20	Pass

Test Graphs


Rx. Spurious NVNT a 5260MHz Ant1 @ 30MHz-1000MHz



Rx. Spurious NVNT a 5260MHz Ant1 @ 1000MHz-26000MHz




Rx. Spurious NVNT a 5300MHz Ant1 @ 30MHz-1000MHz

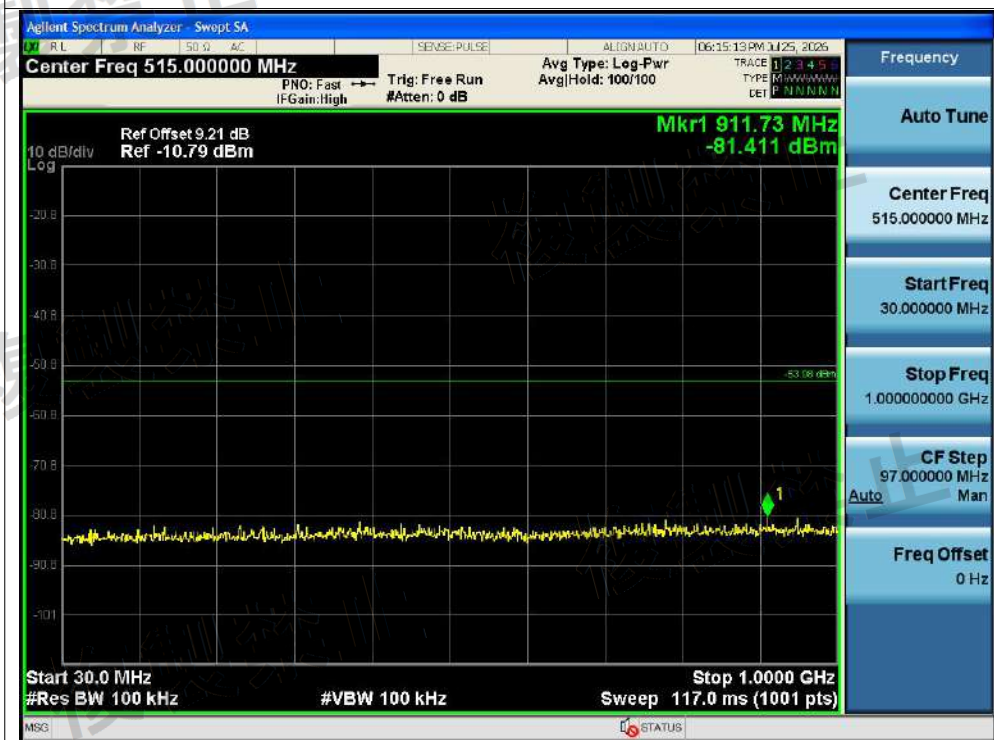

Rx. Spurious NVNT a 5300MHz Ant1 @ 1000MHz-26000MHz





Rx. Spurious NVNT a 5320MHz Ant1 @ 30MHz-1000MHz

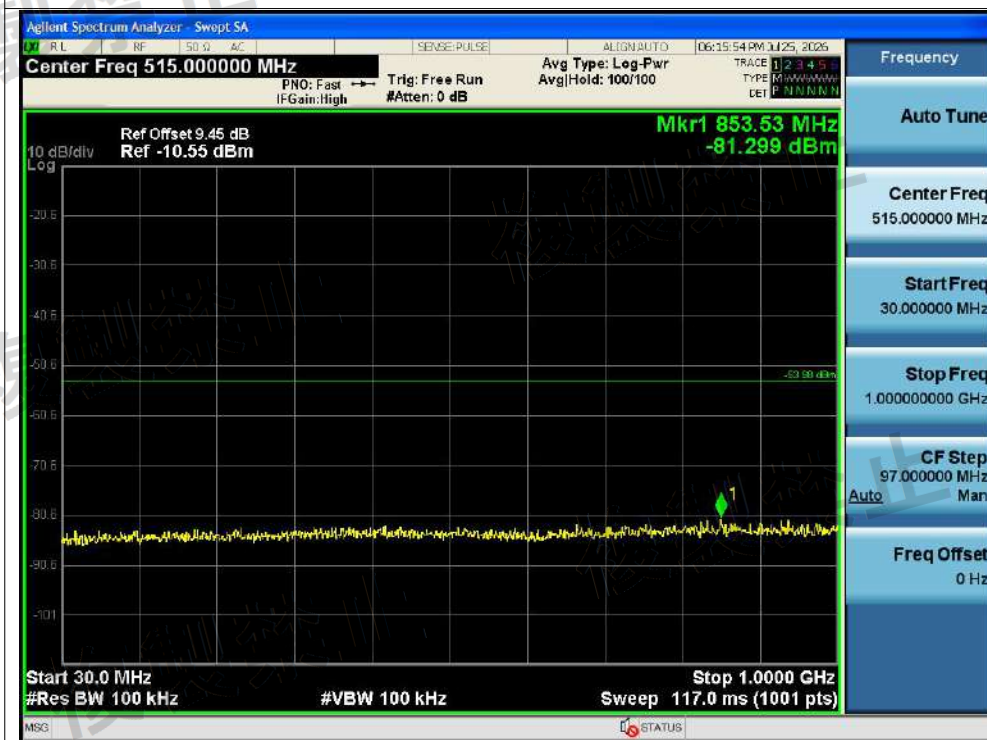


Rx. Spurious NVNT a 5320MHz Ant1 @ 1000MHz-26000MHz



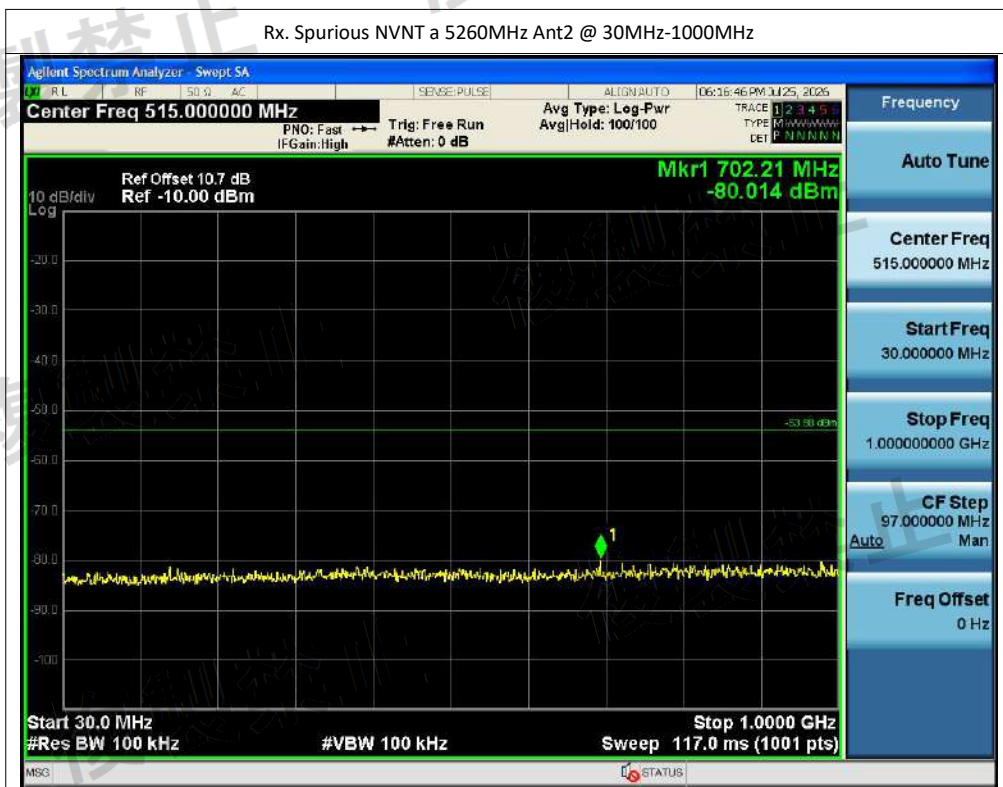

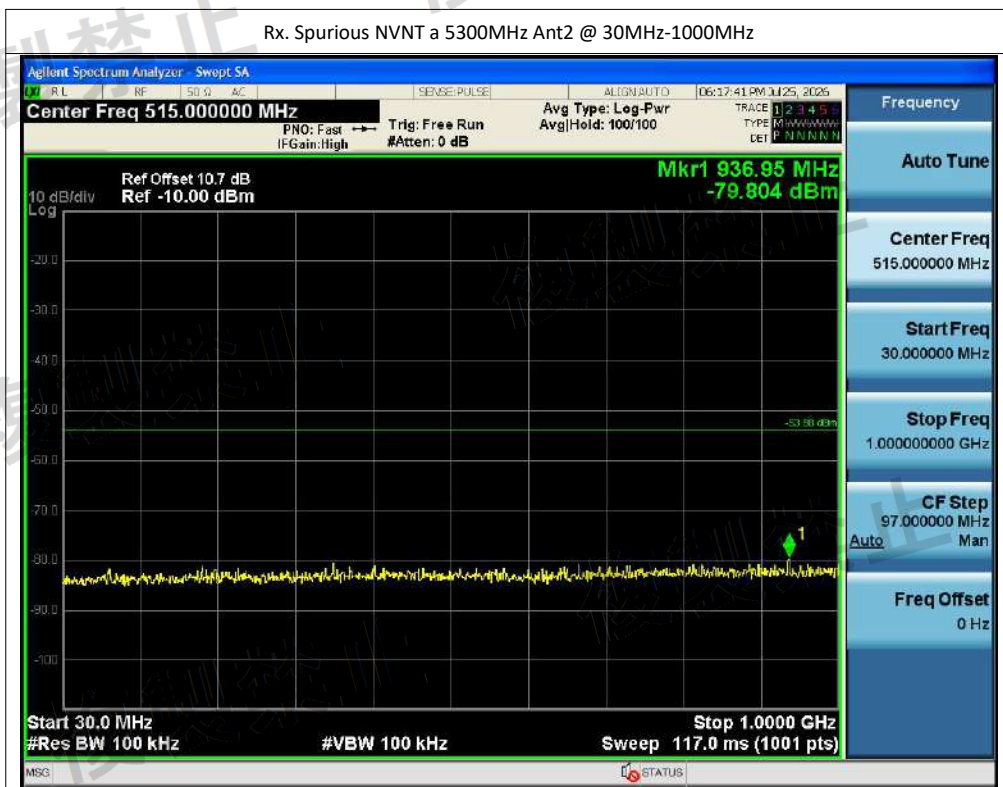


Rx. Spurious NVNT a 5320MHz Ant2 @ 30MHz-1000MHz

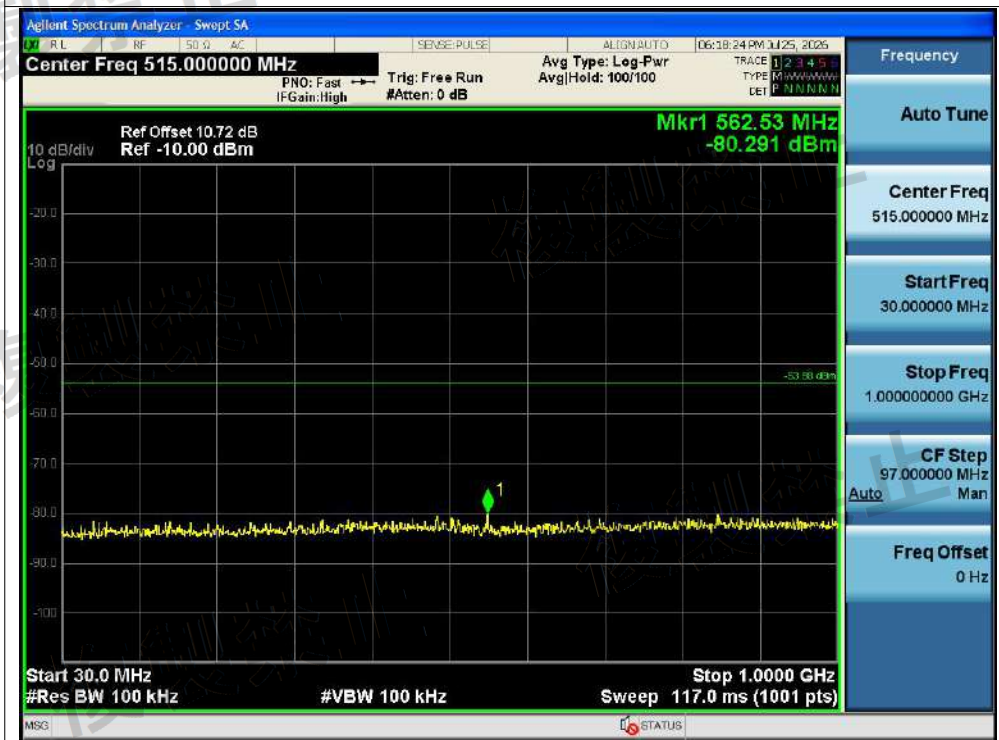

Rx. Spurious NVNT a 5320MHz Ant2 @ 1000MHz-26000MHz



Rx. Spurious NVNT a 5260MHz Ant3 @ 30MHz-1000MHz

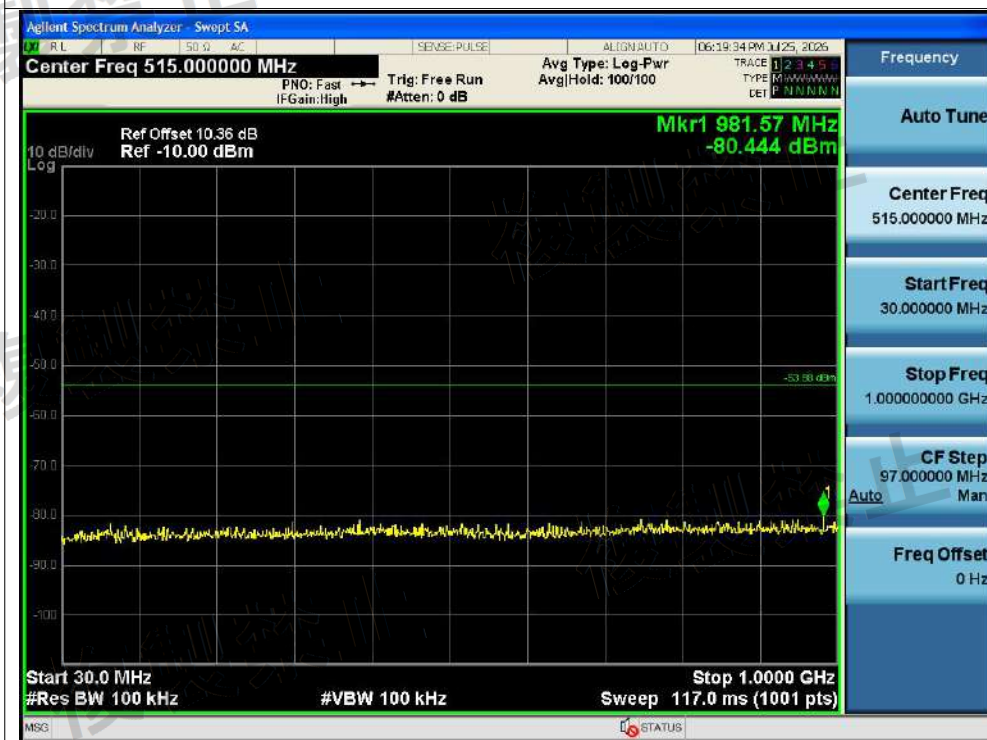

Rx. Spurious NVNT a 5260MHz Ant3 @ 1000MHz-26000MHz





Rx. Spurious NVNT a 5300MHz Ant3 @ 30MHz-1000MHz





Rx. Spurious NVNT a 5300MHz Ant3 @ 1000MHz-26000MHz




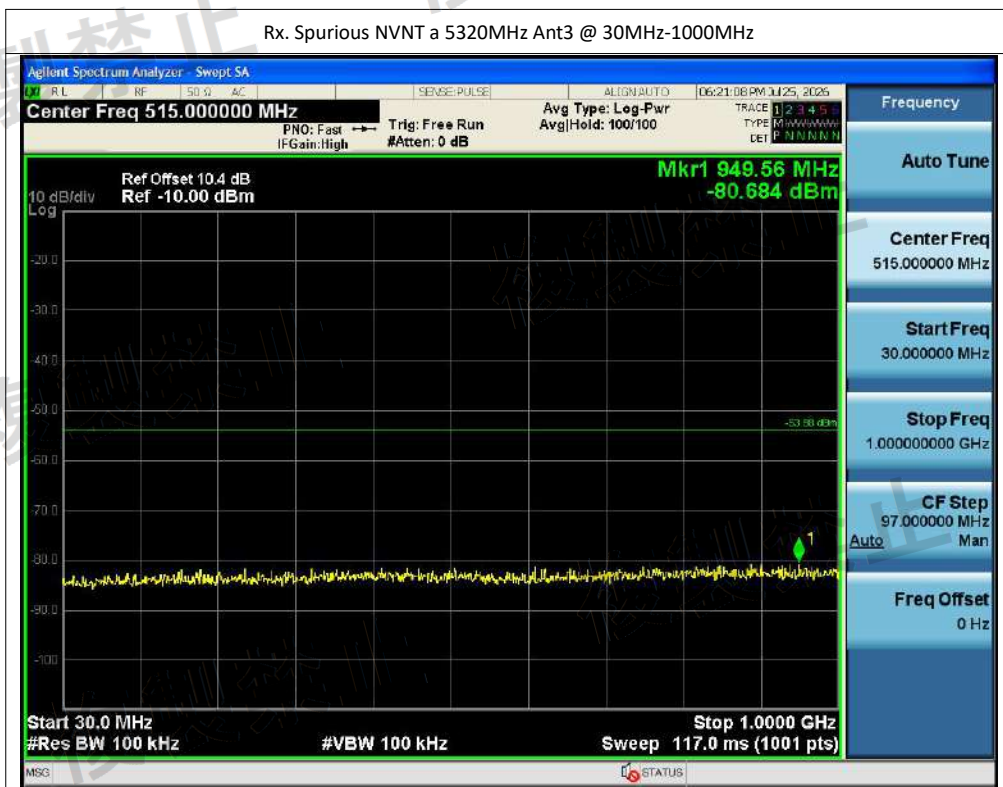


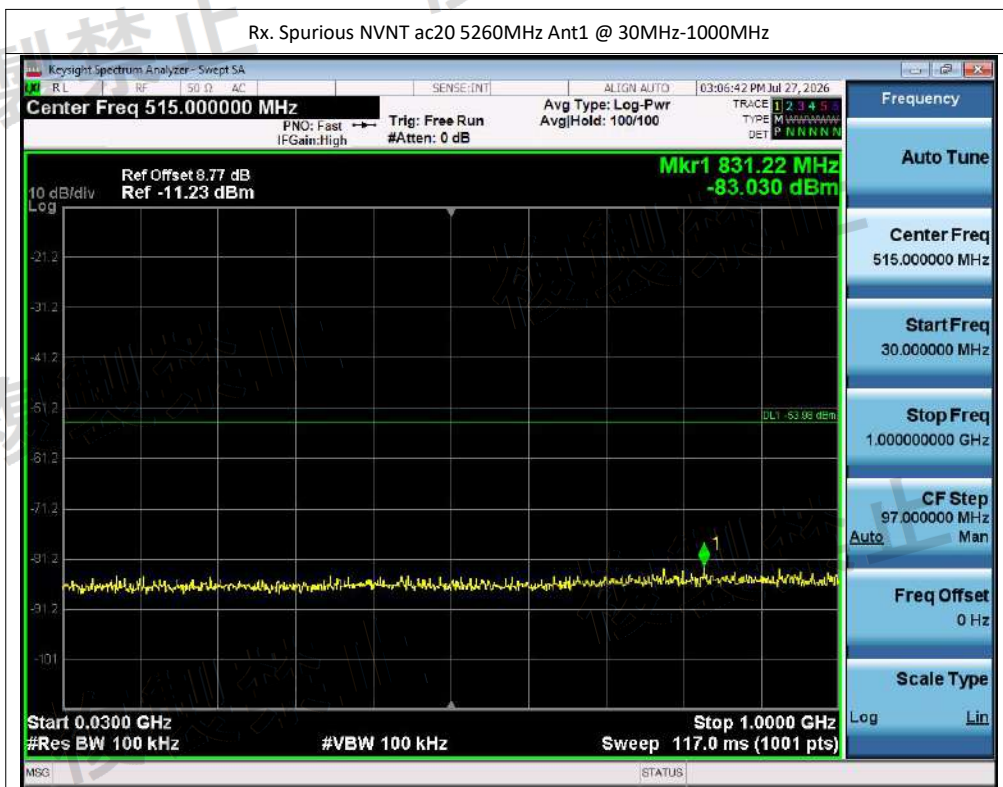


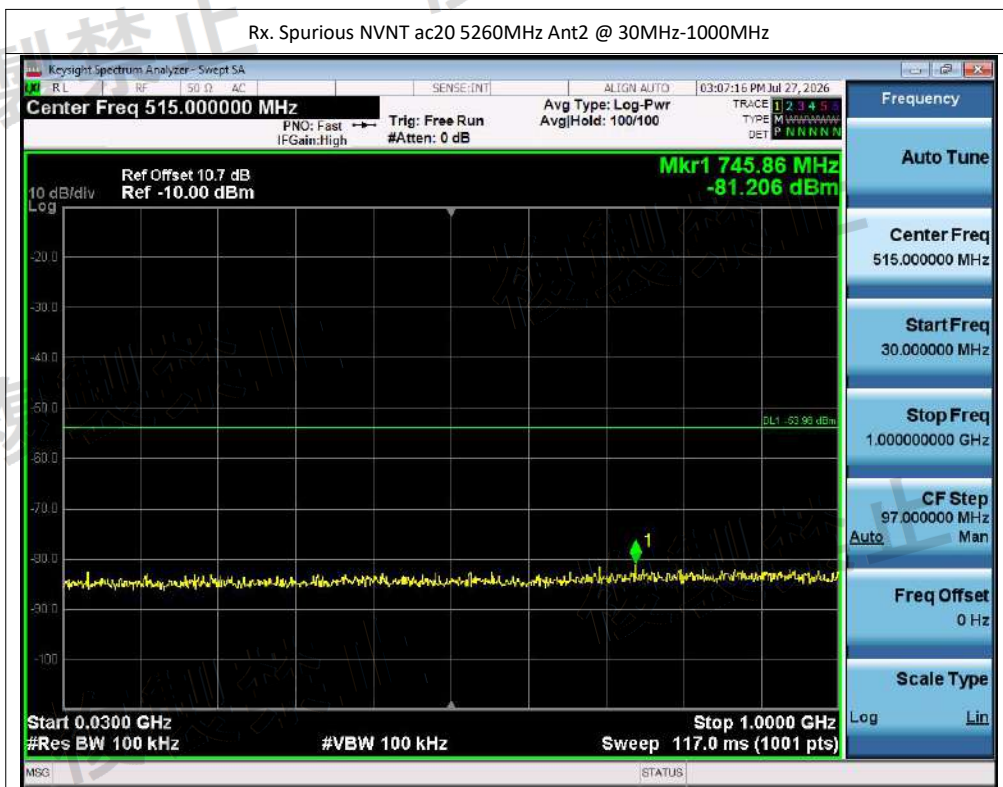


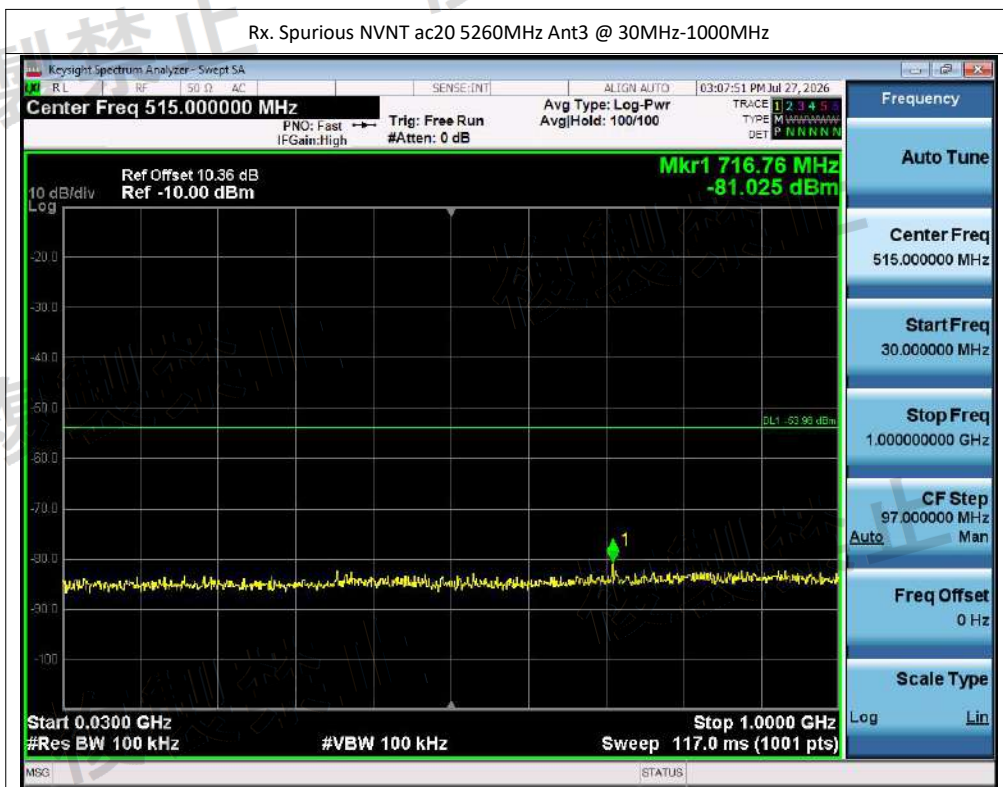


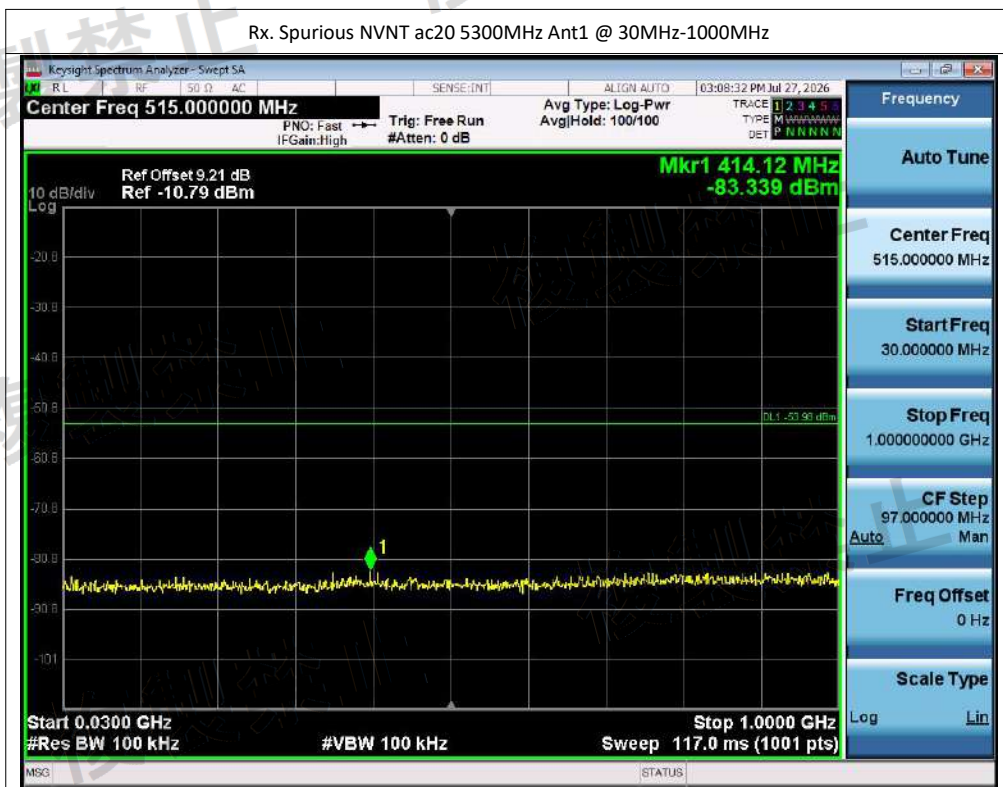


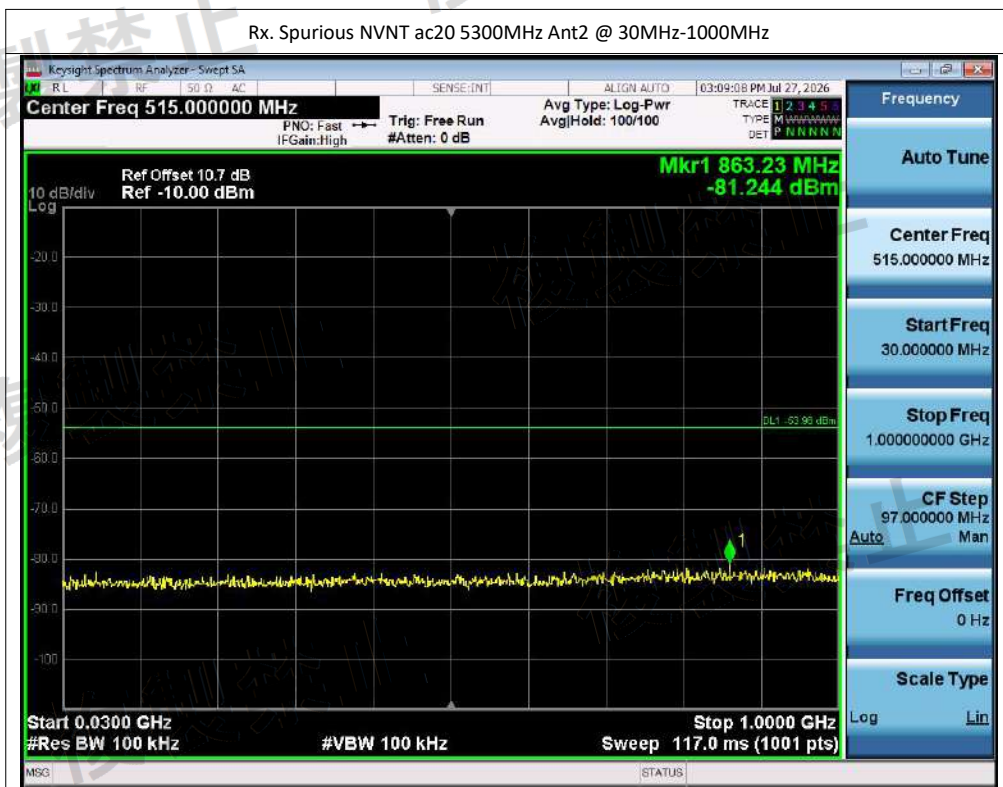


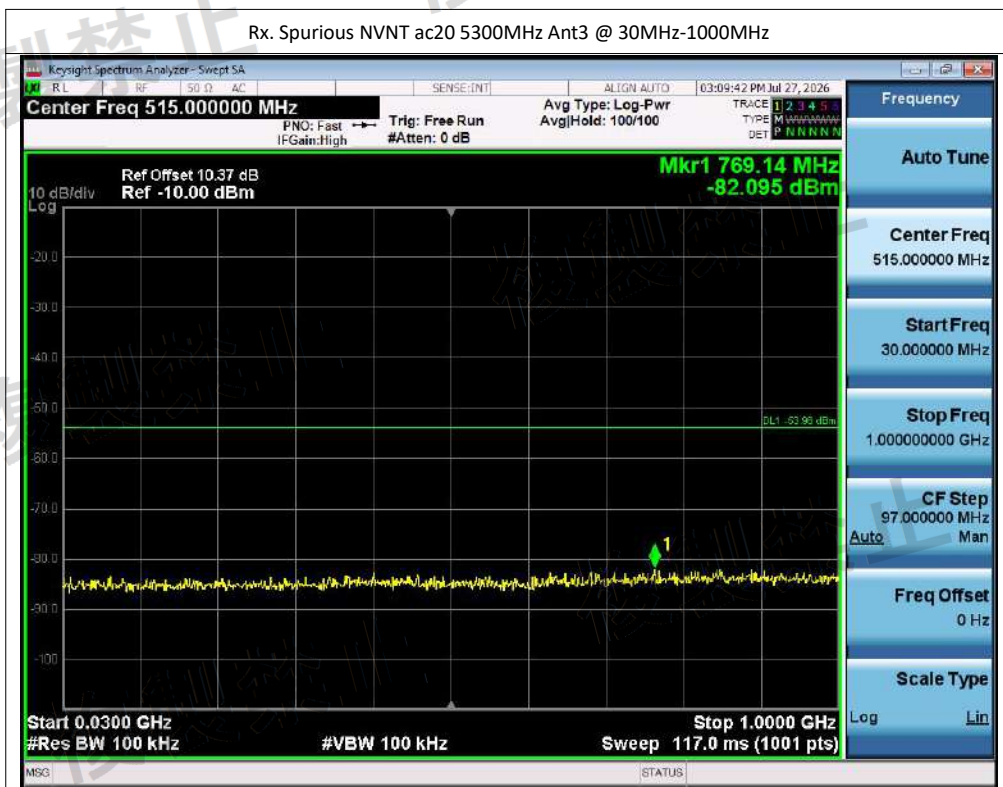


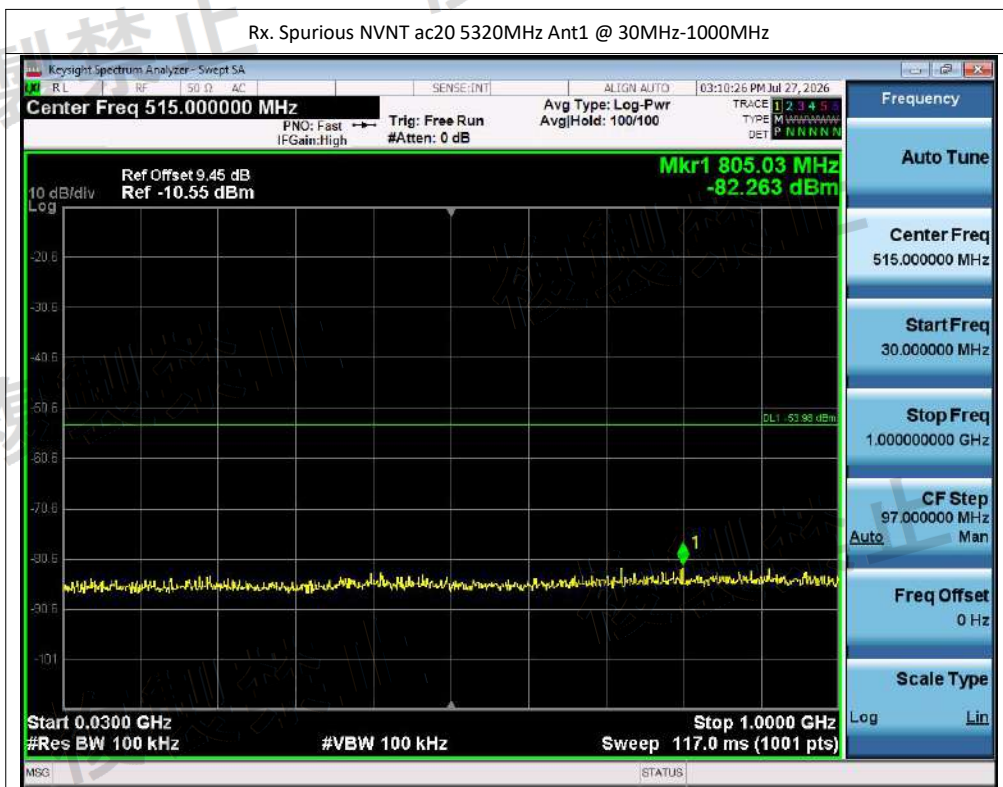


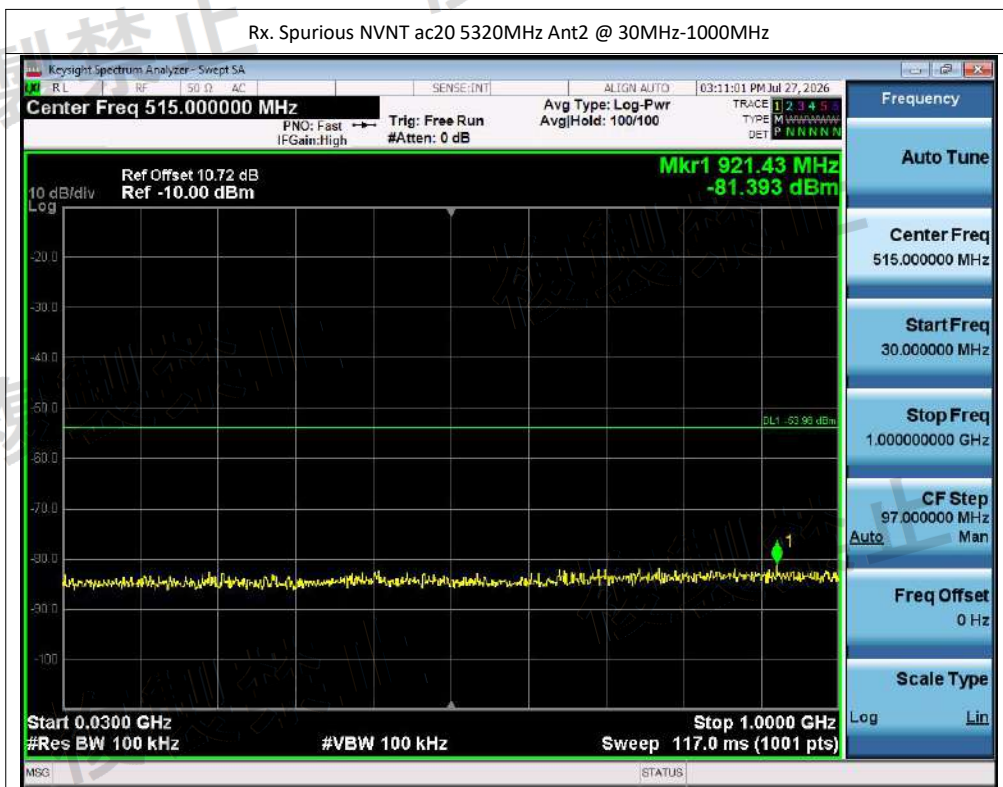


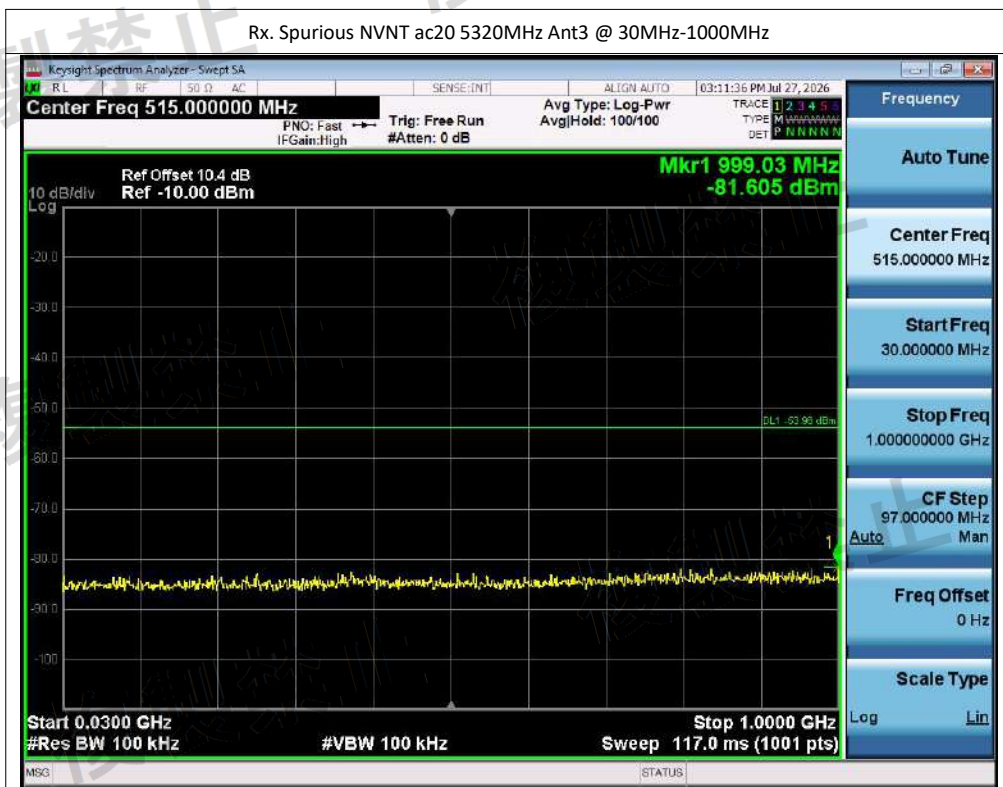


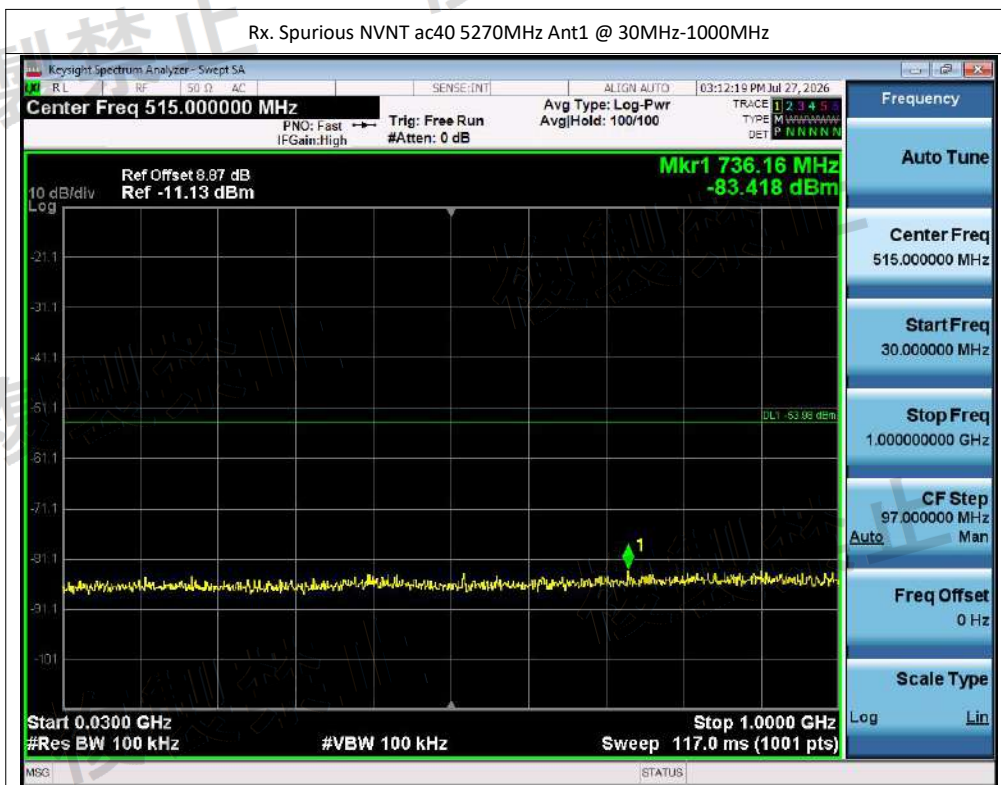


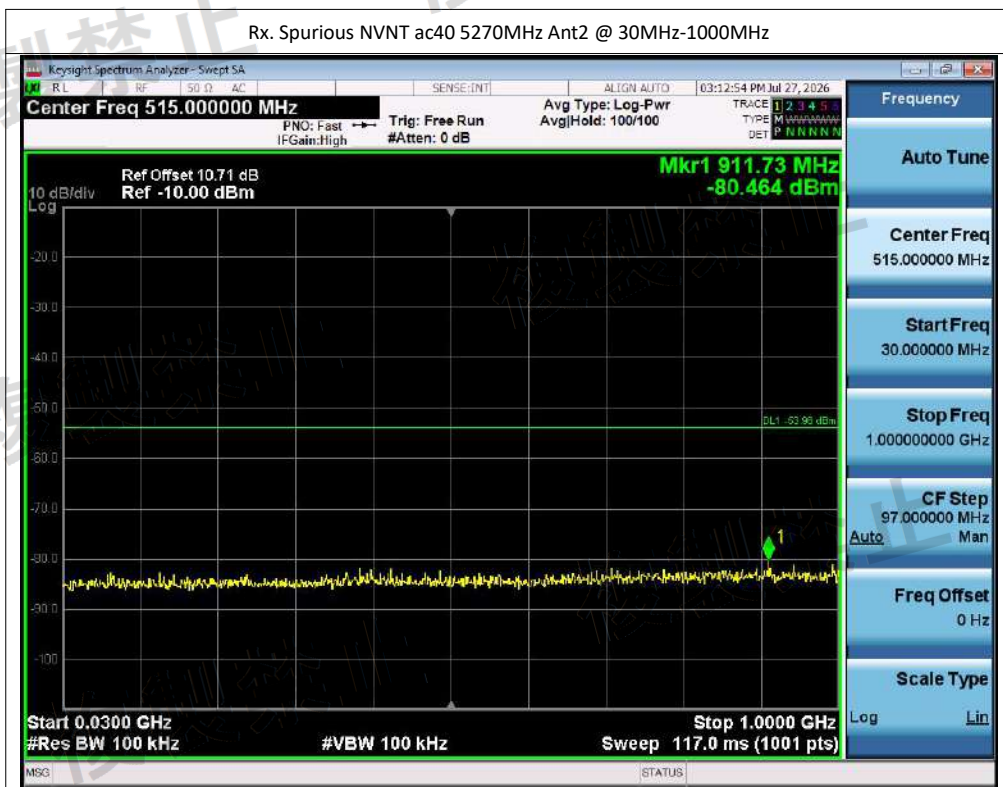


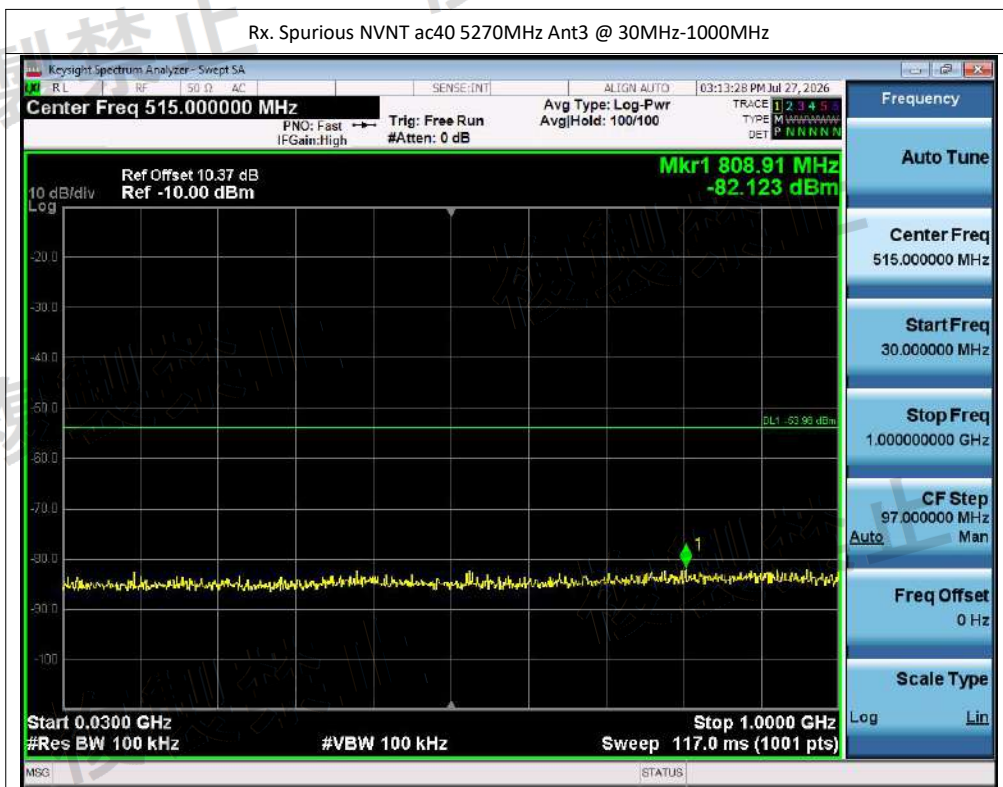


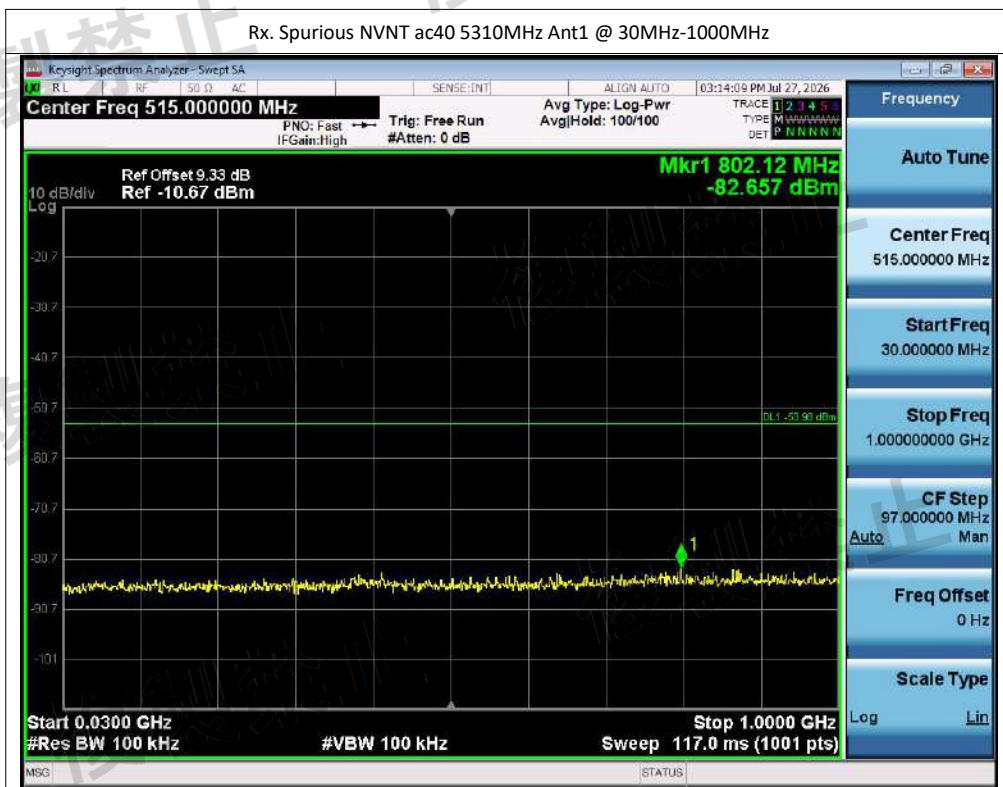


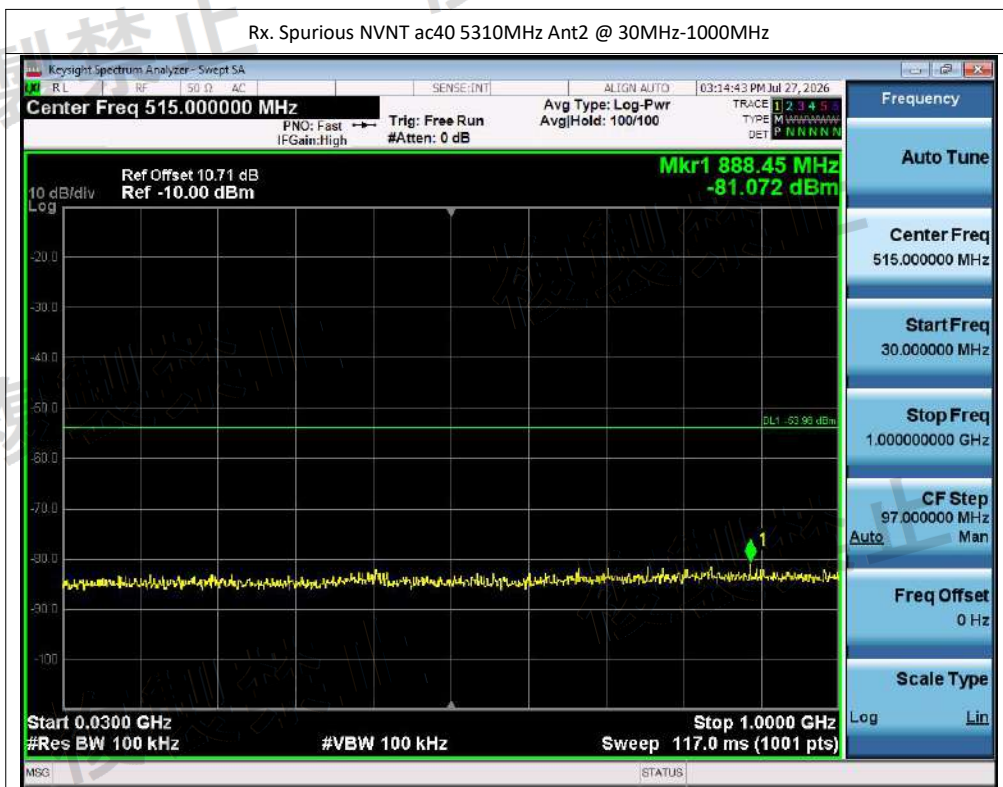


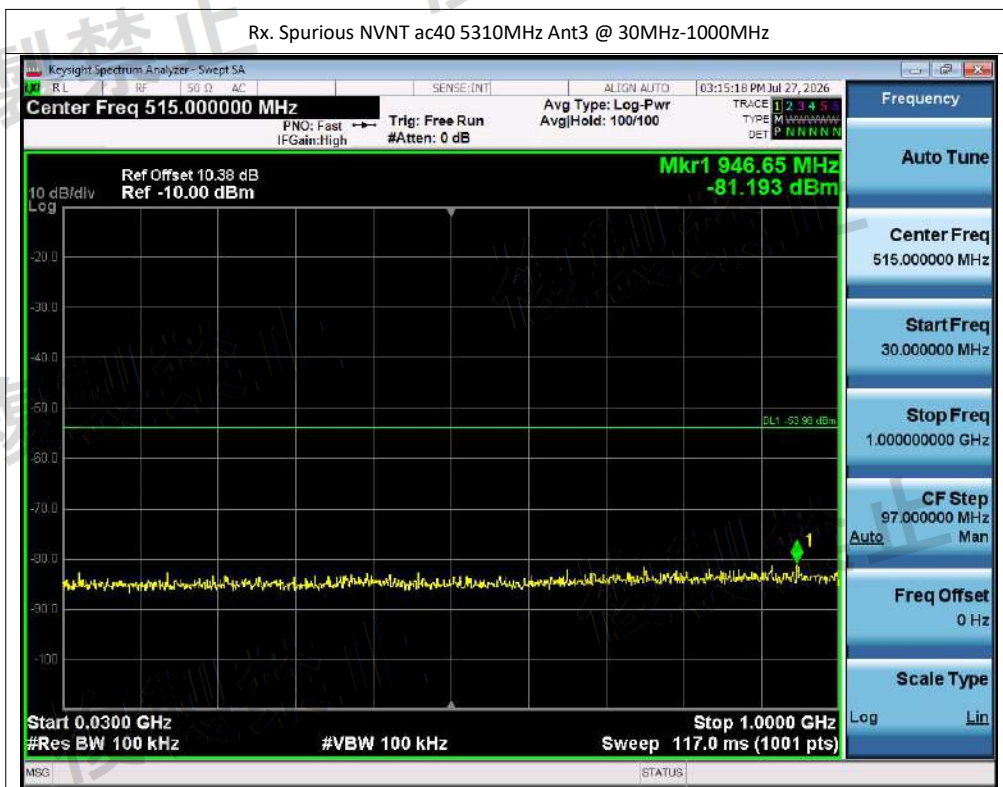


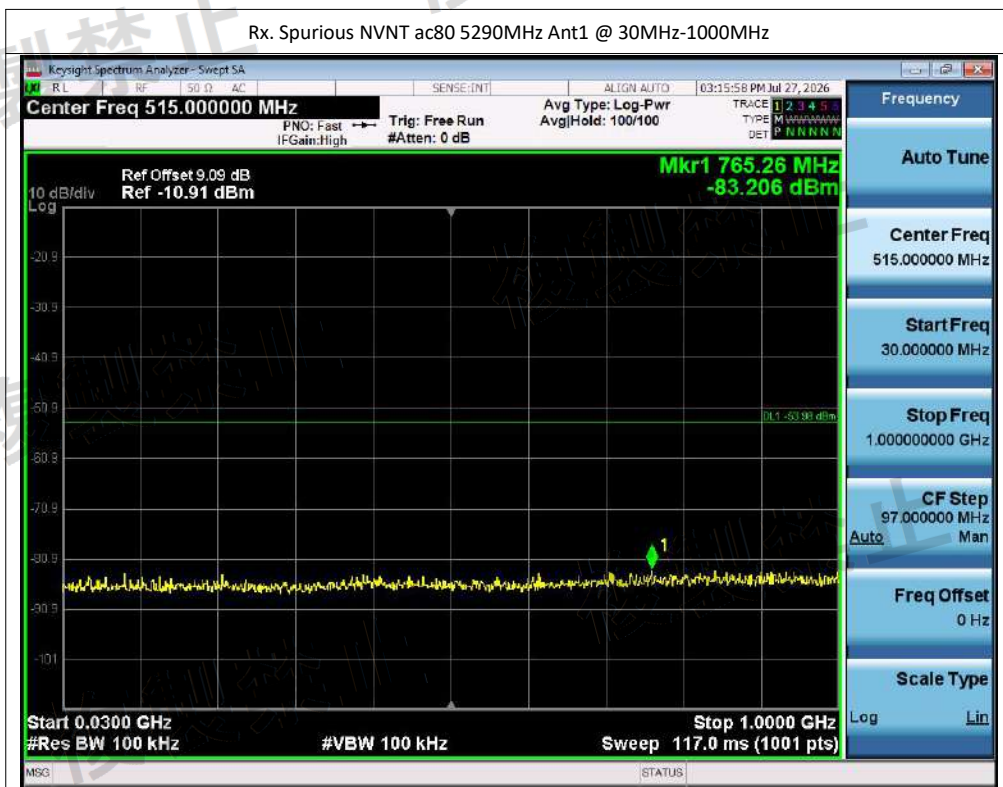


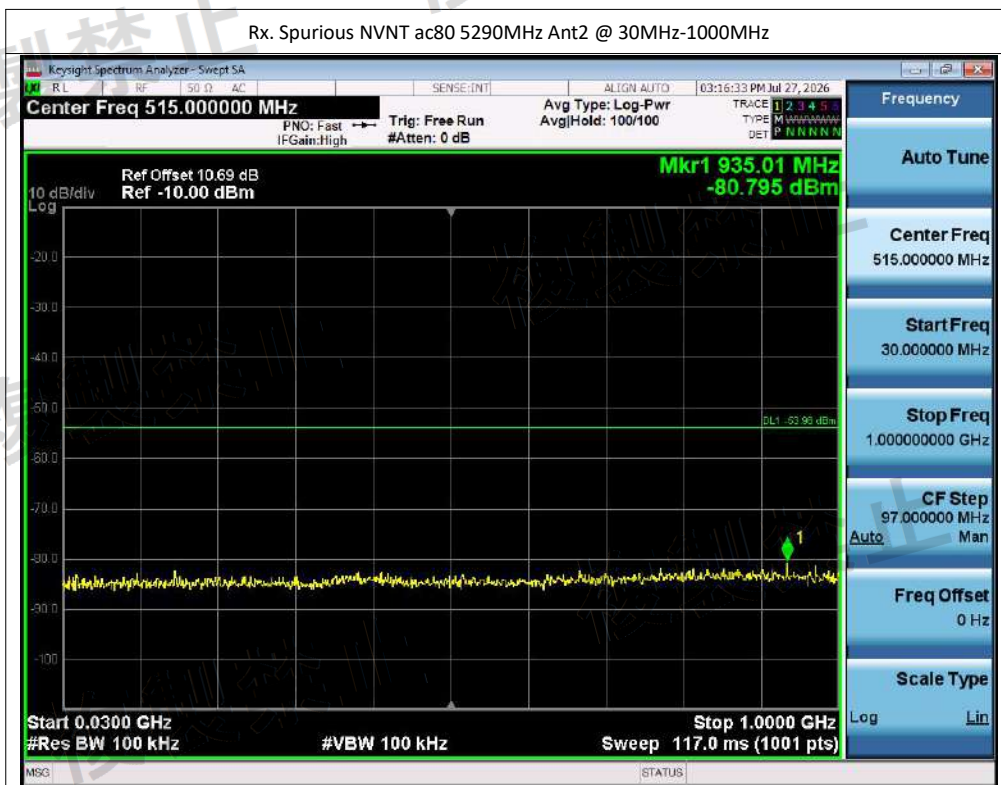


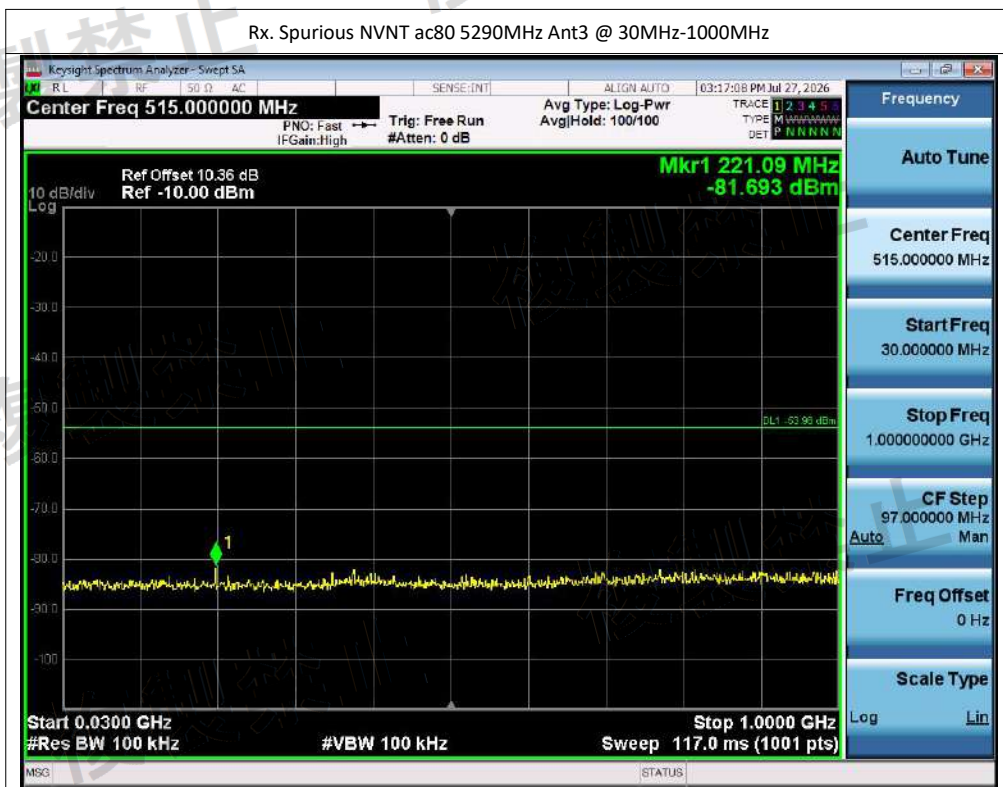


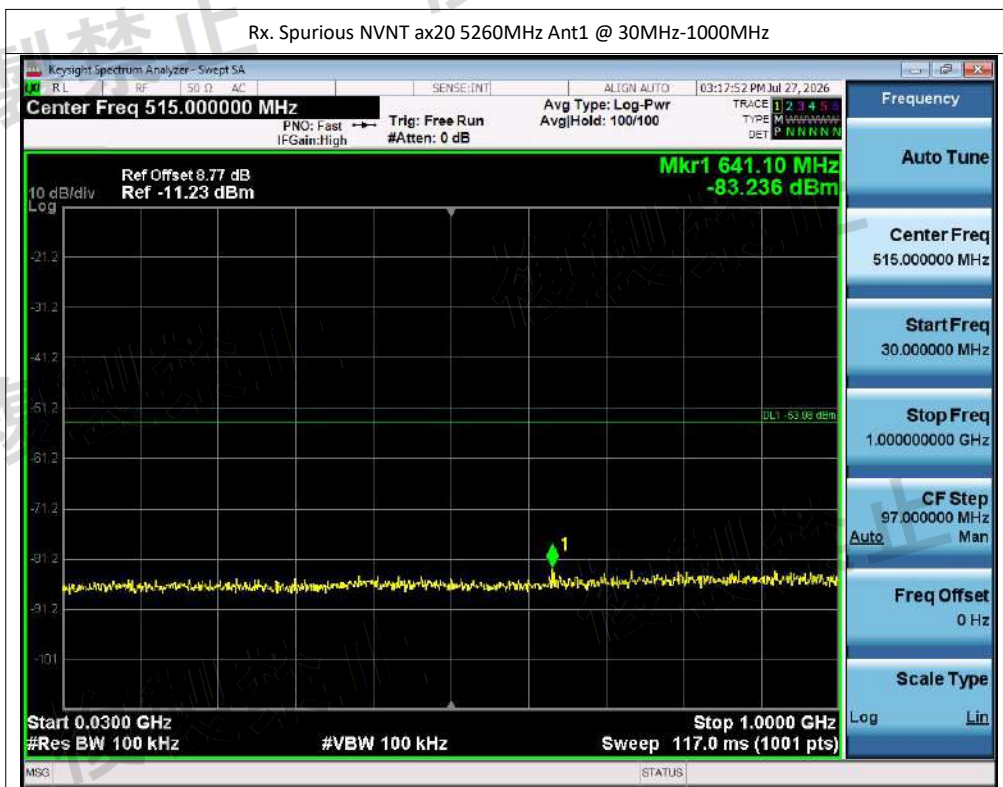


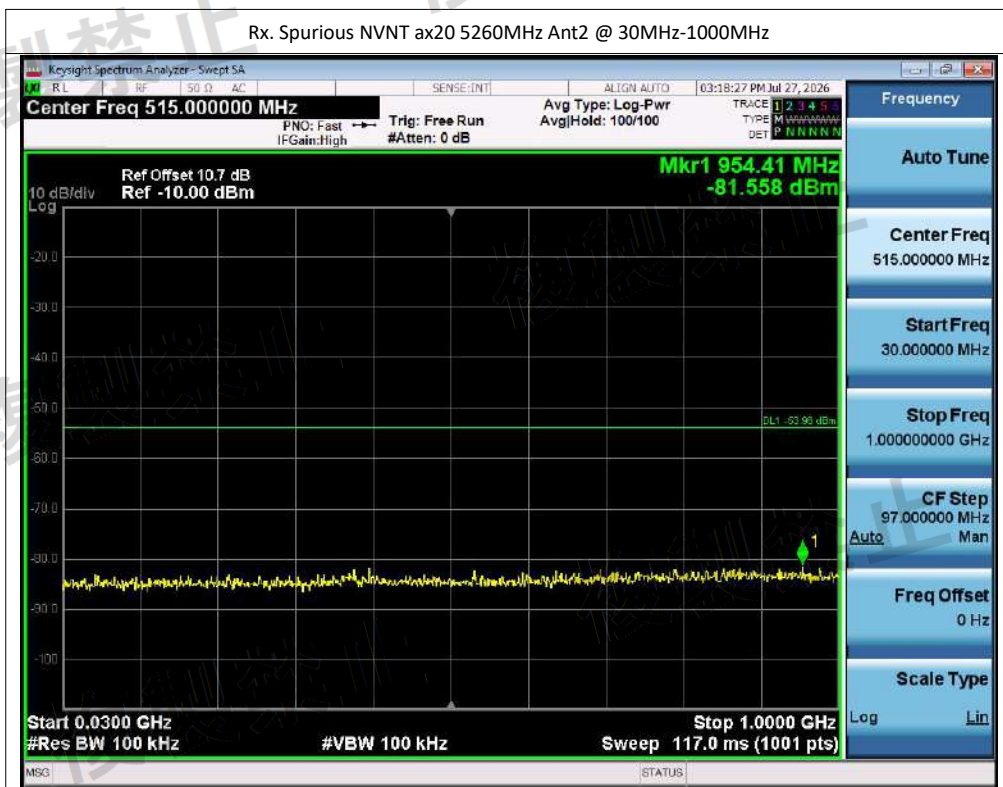


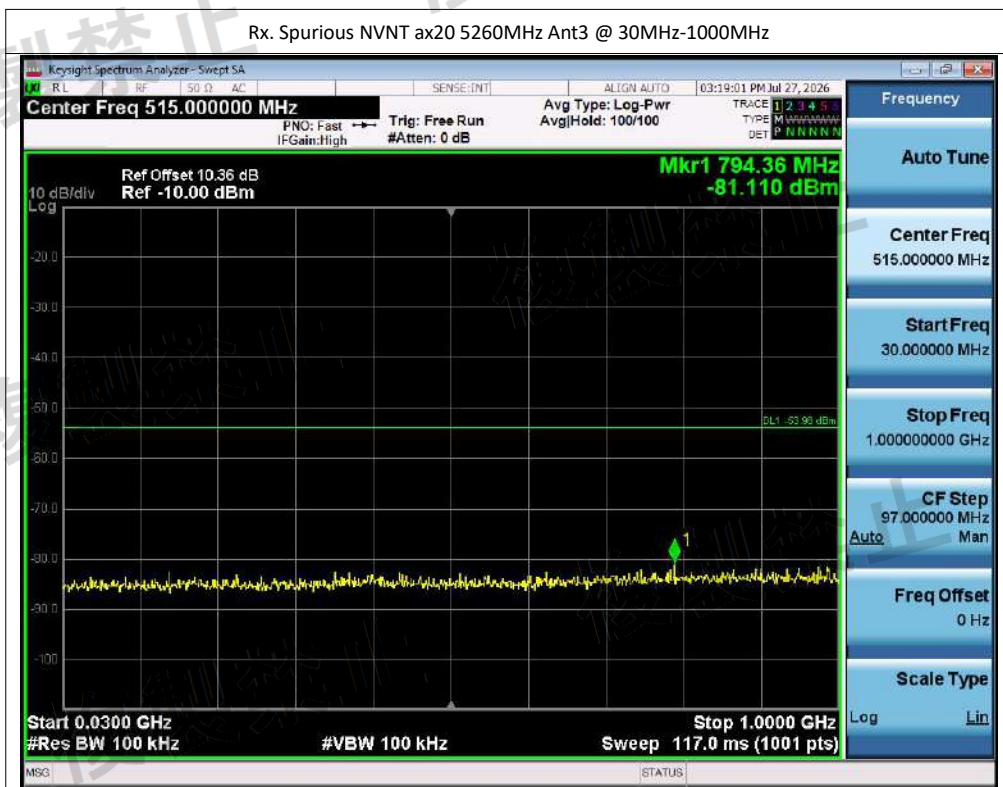


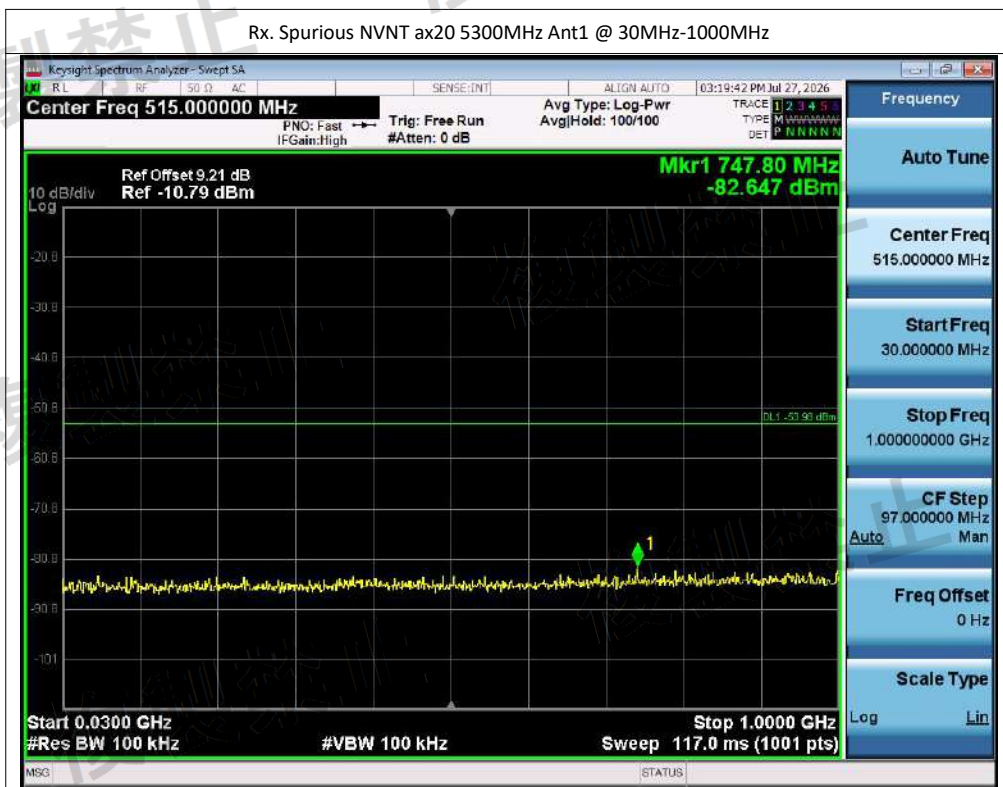


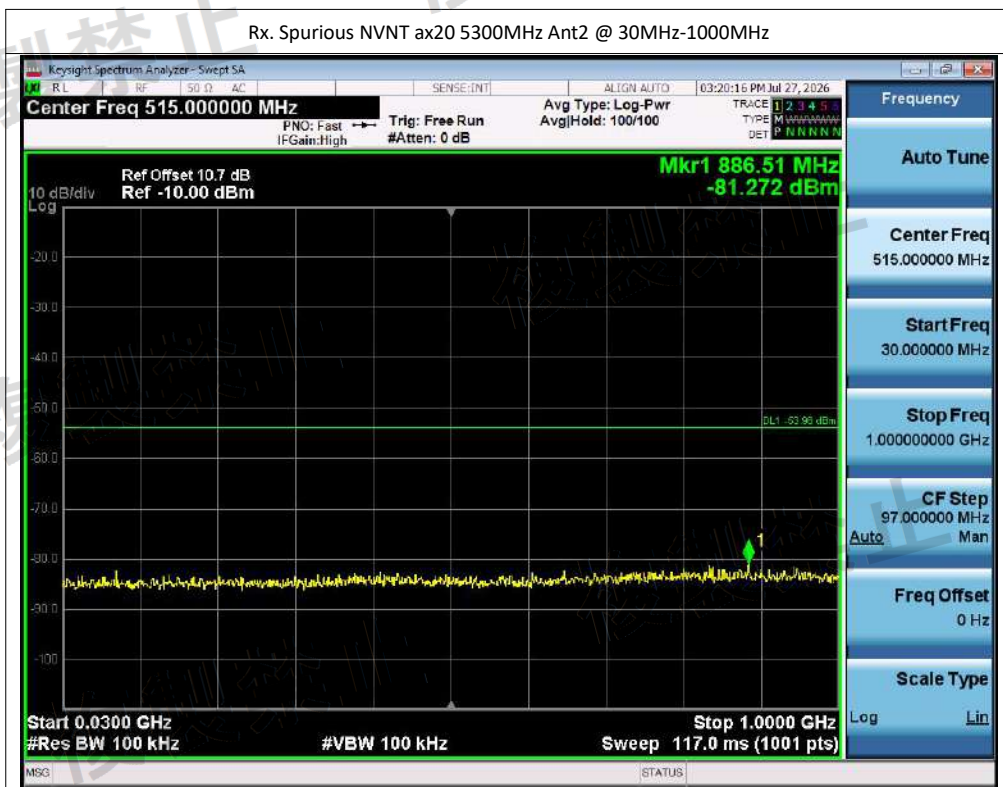


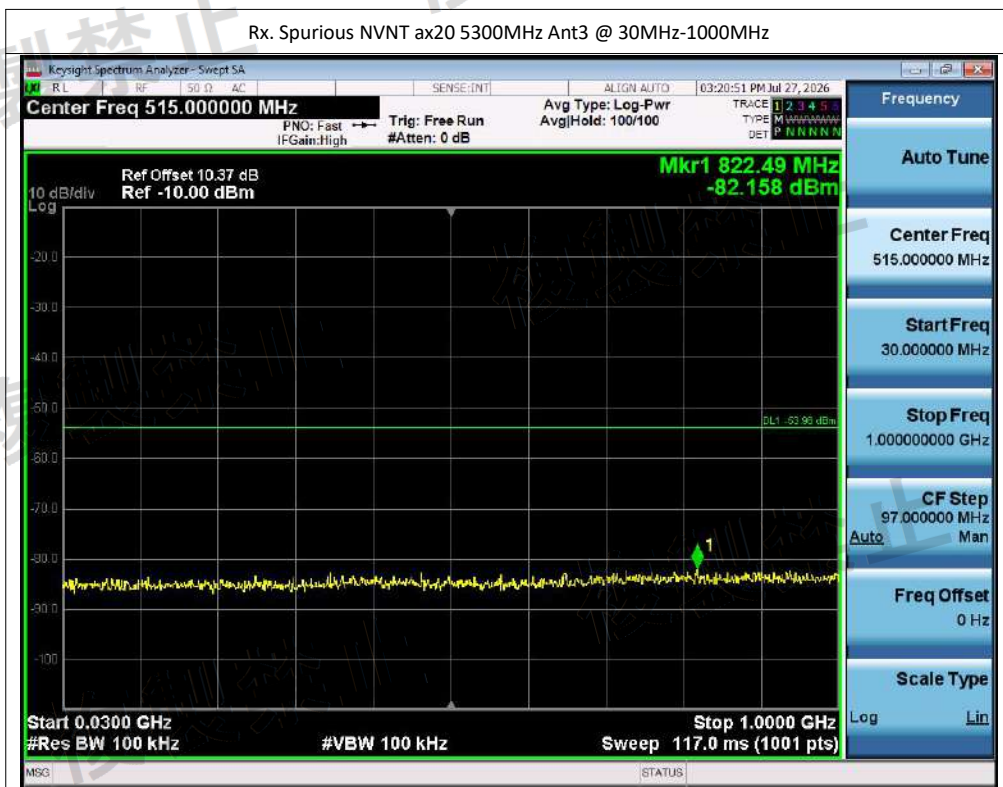


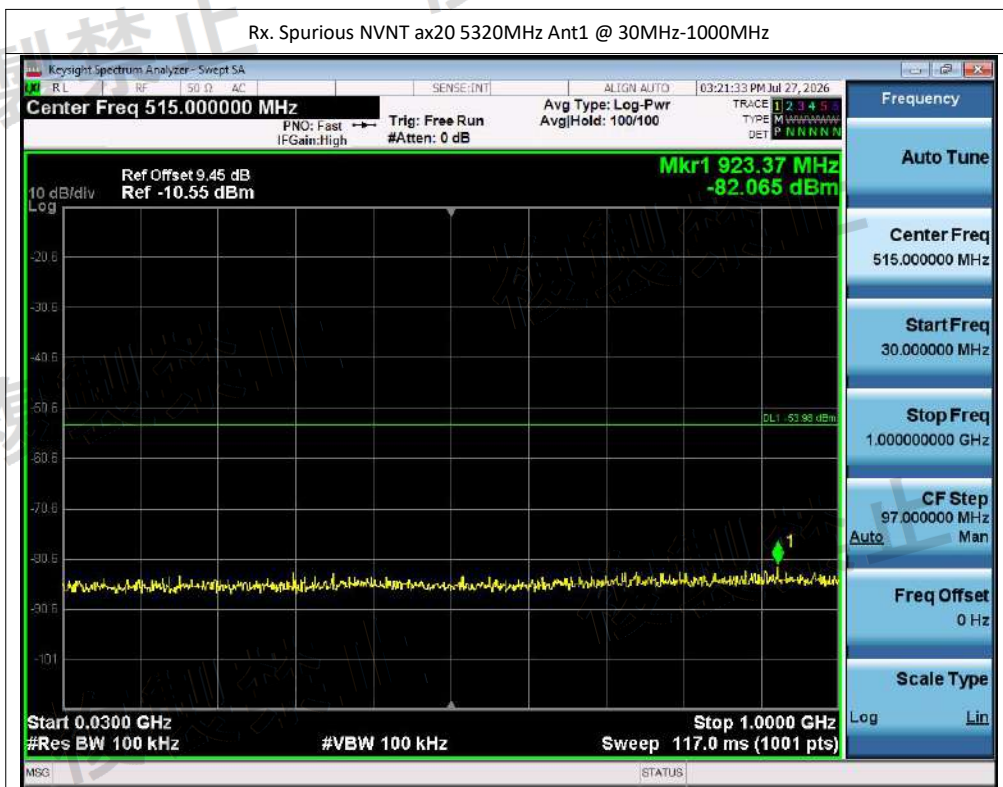


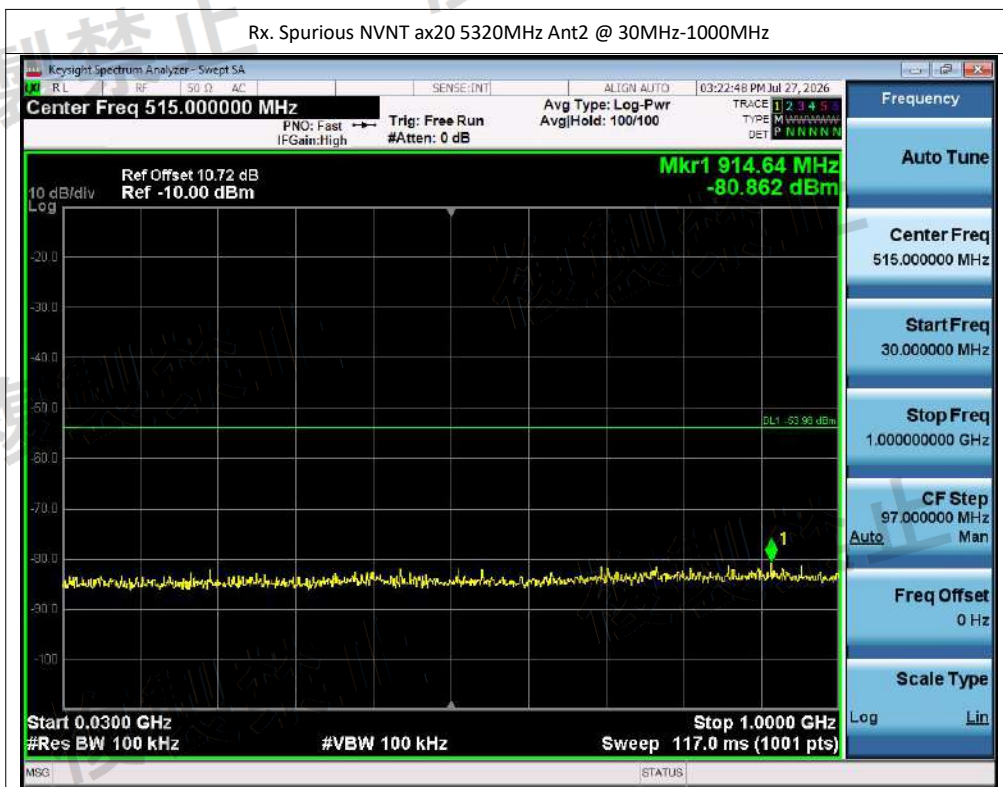


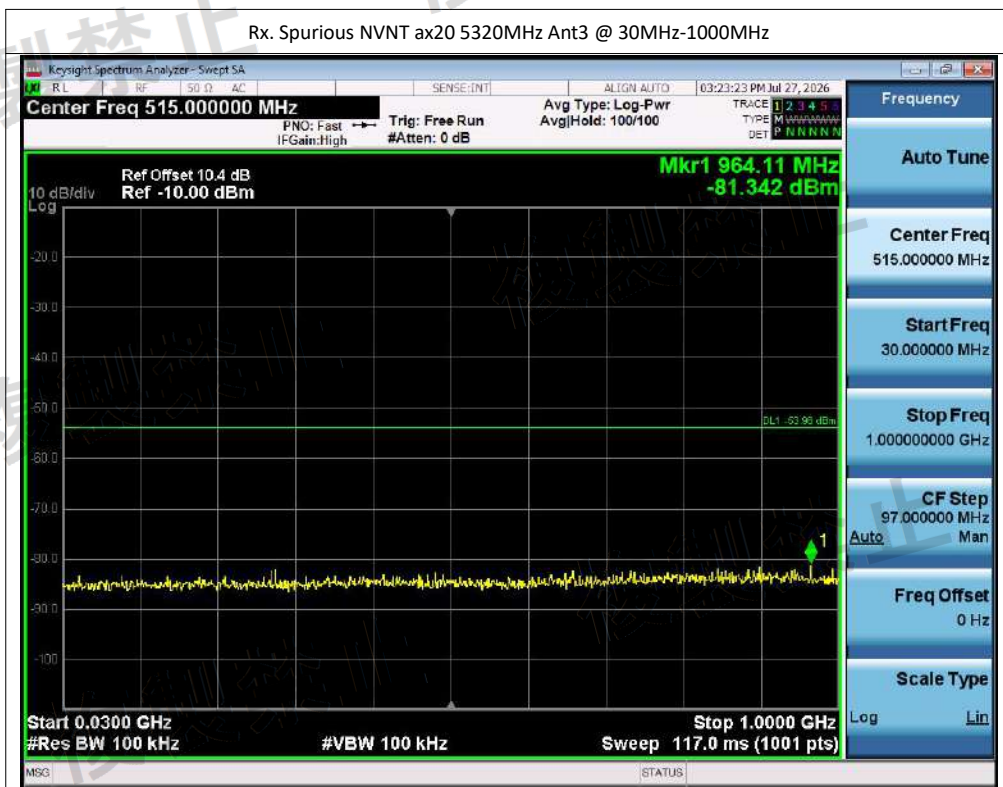


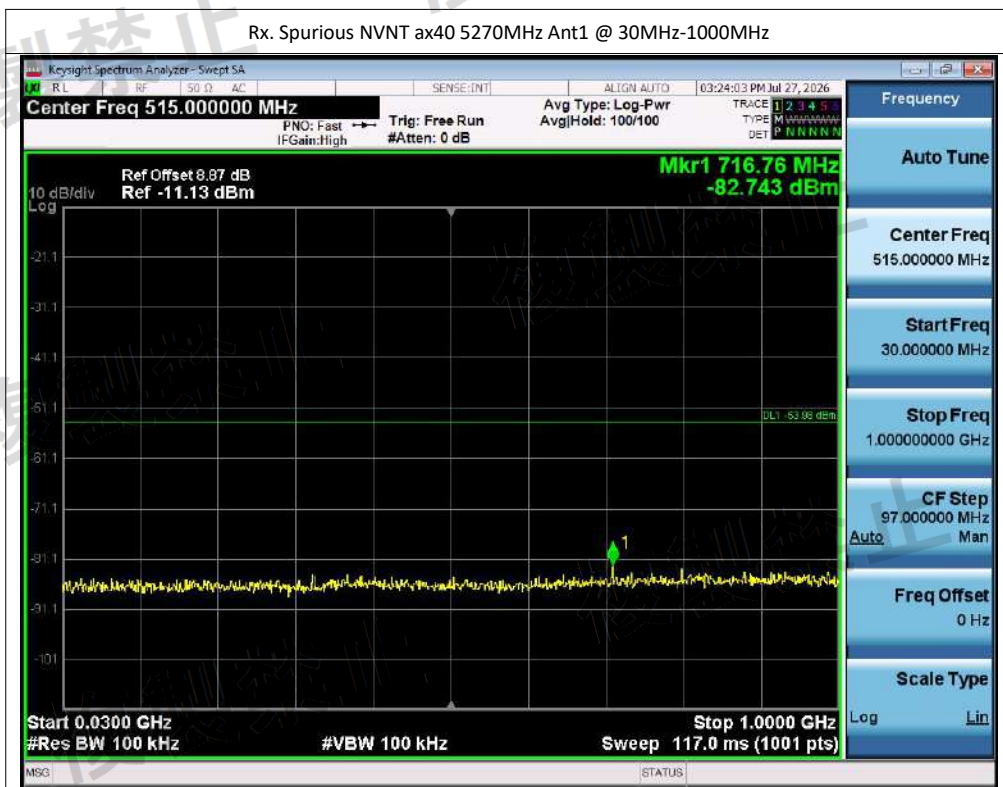


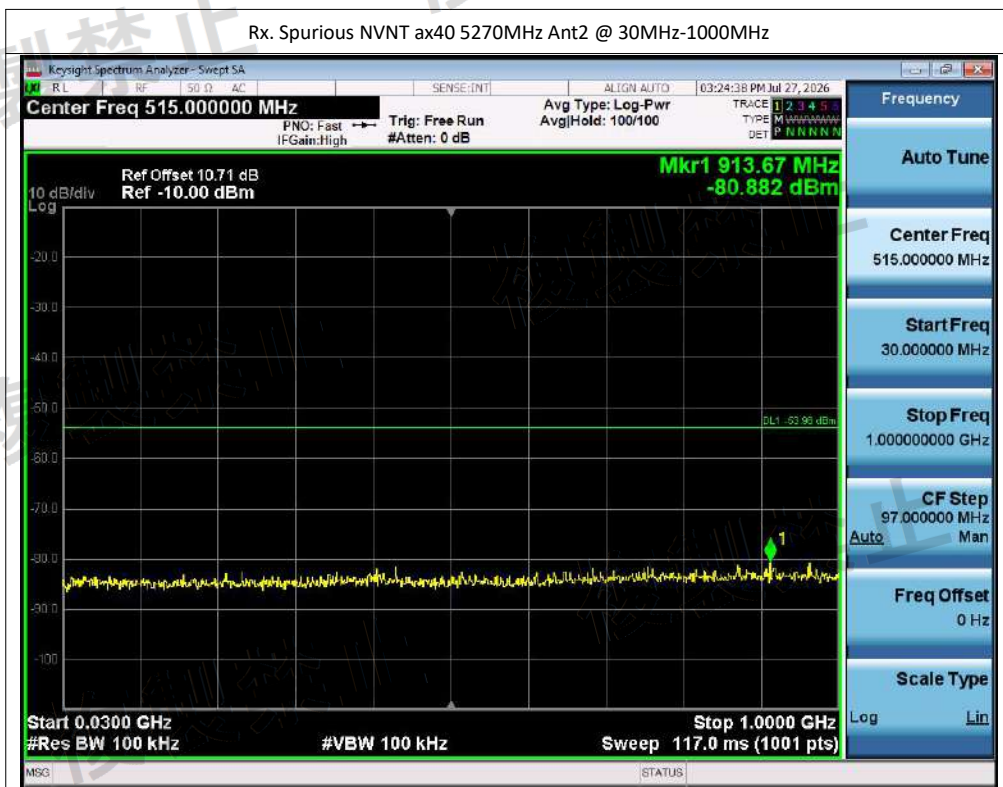


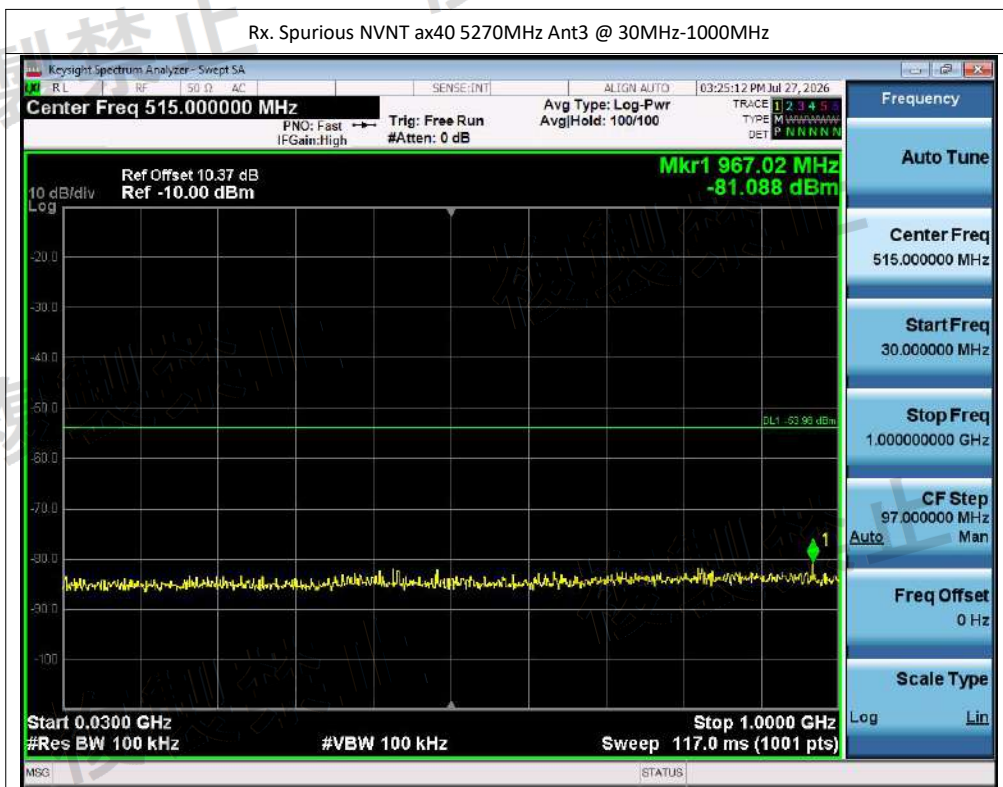


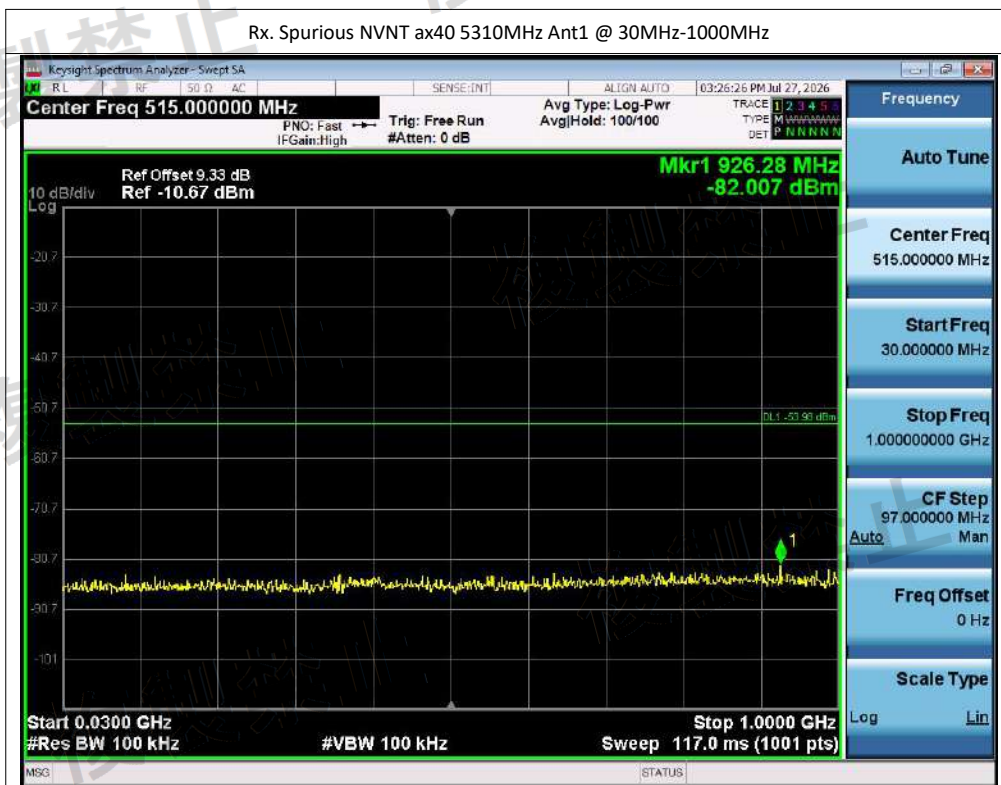


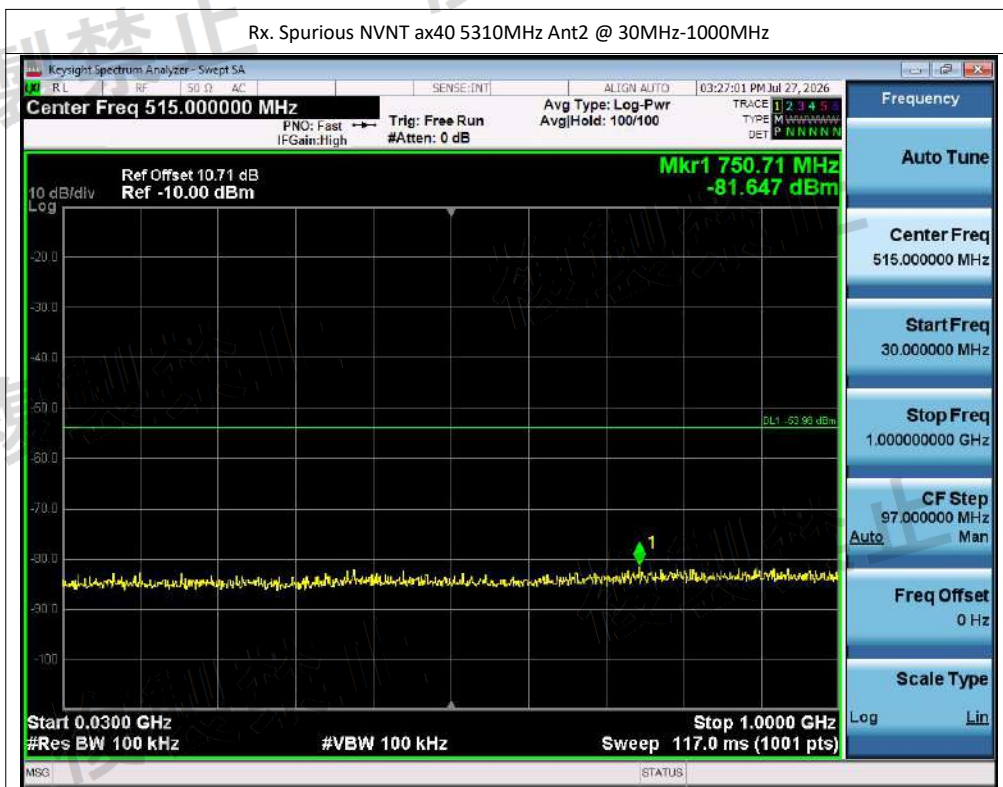


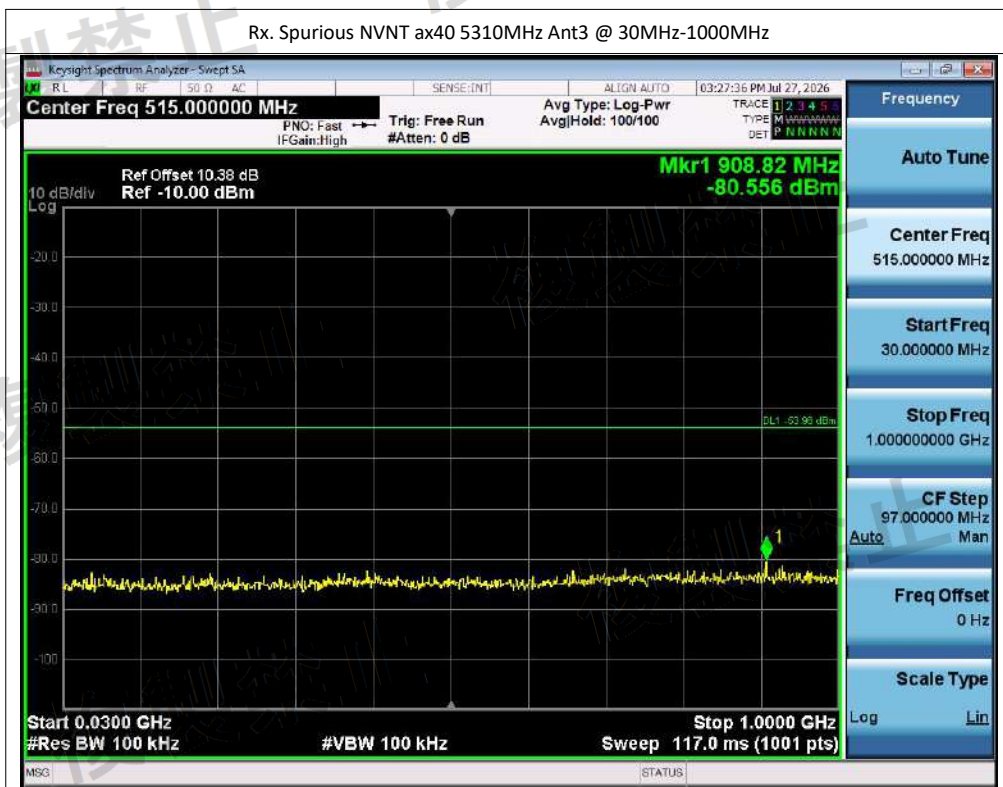


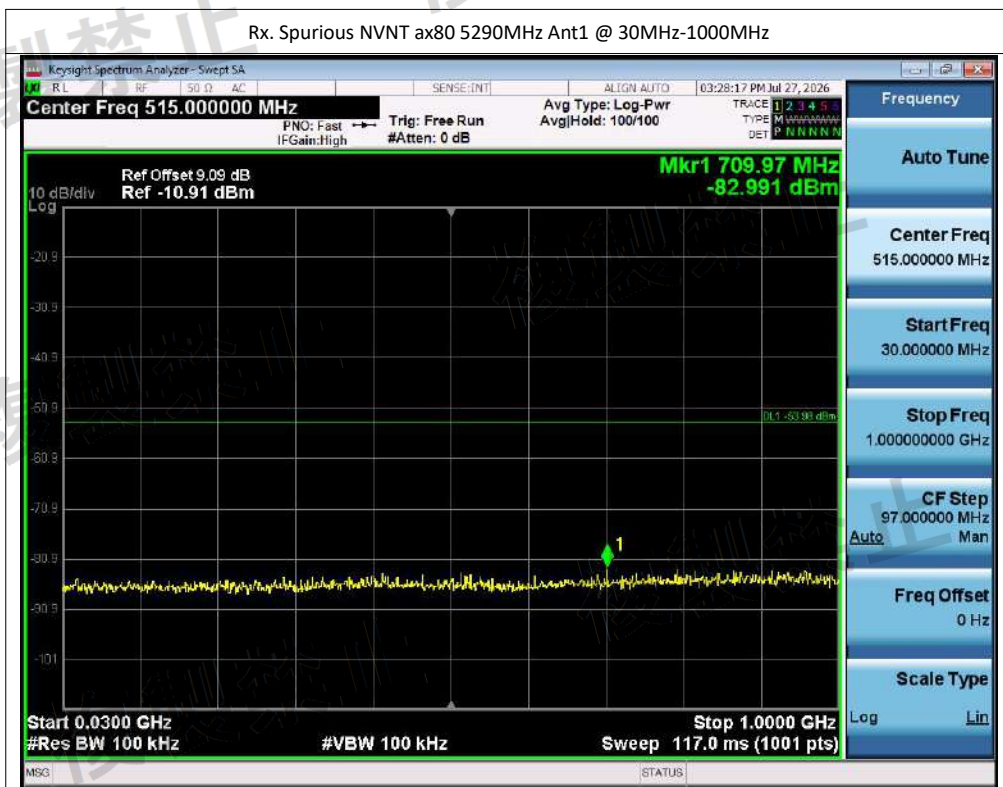

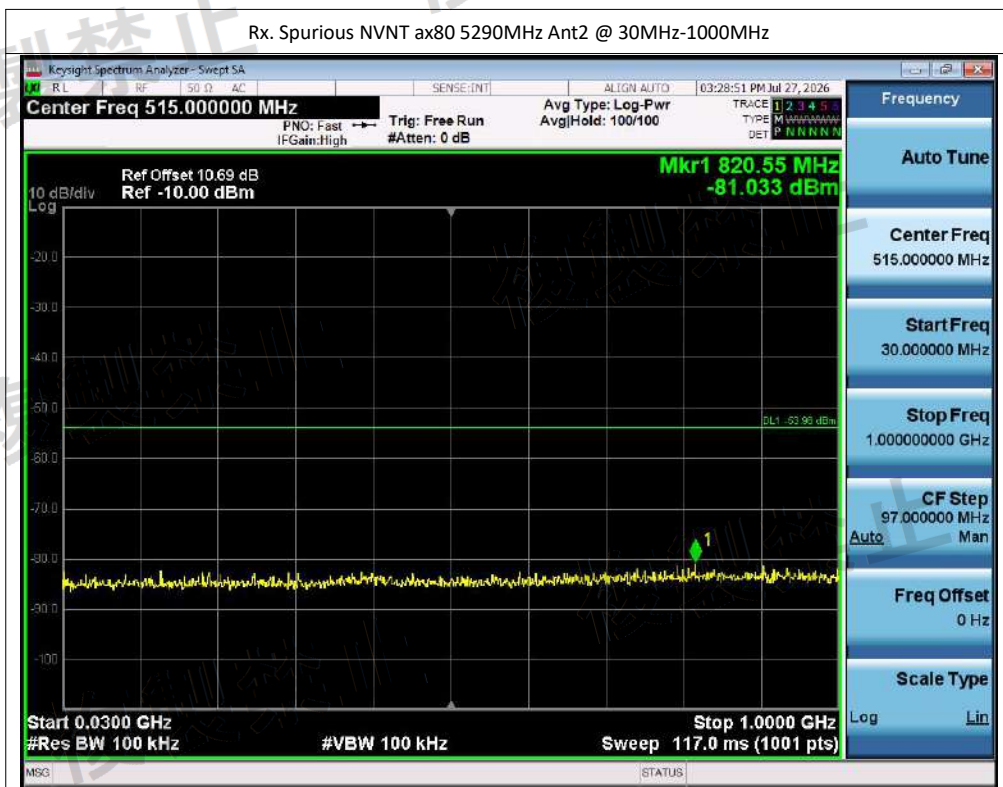


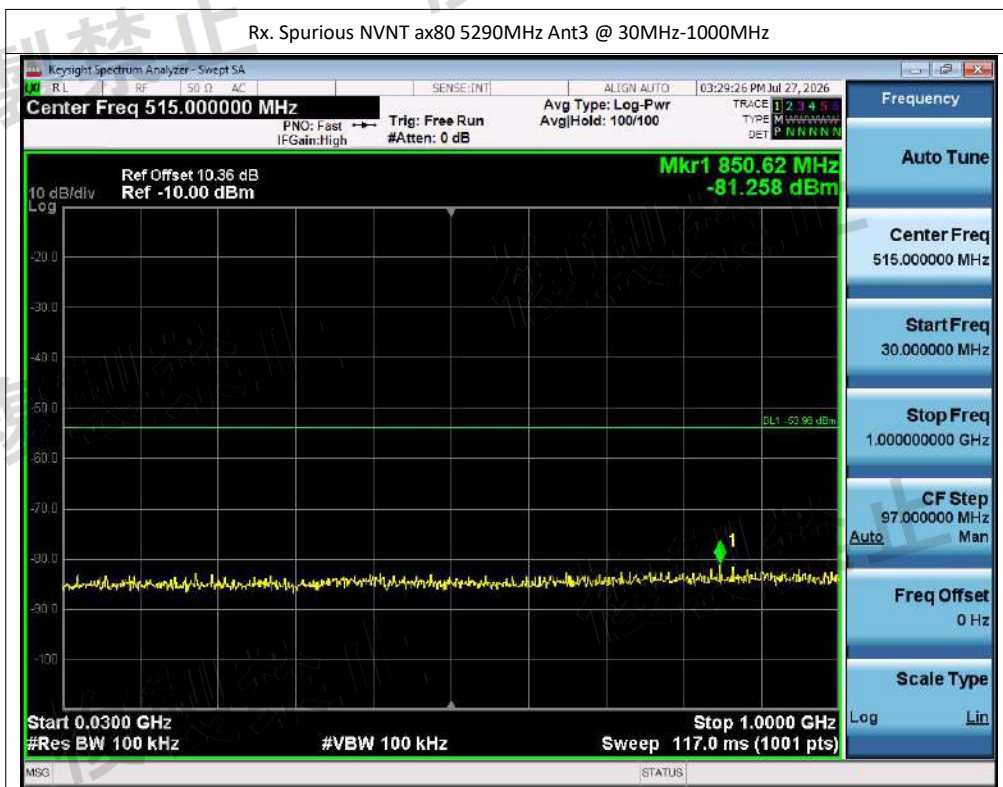

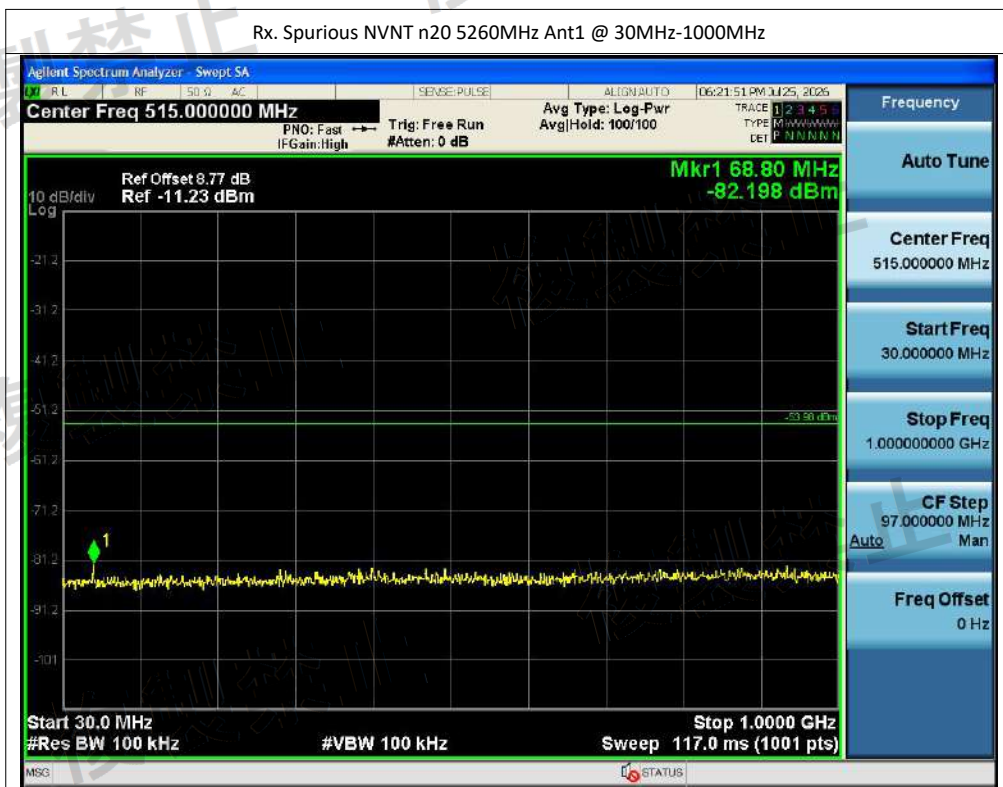

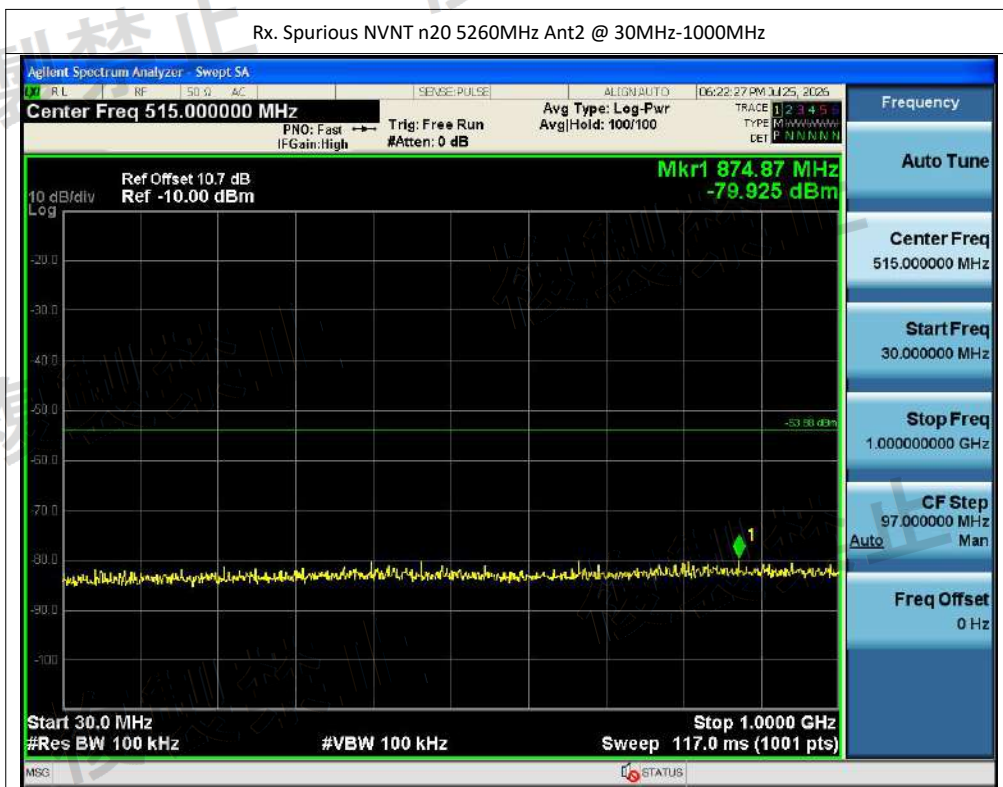



Rx. Spurious NVNT n20 5260MHz Ant3 @ 30MHz-1000MHz

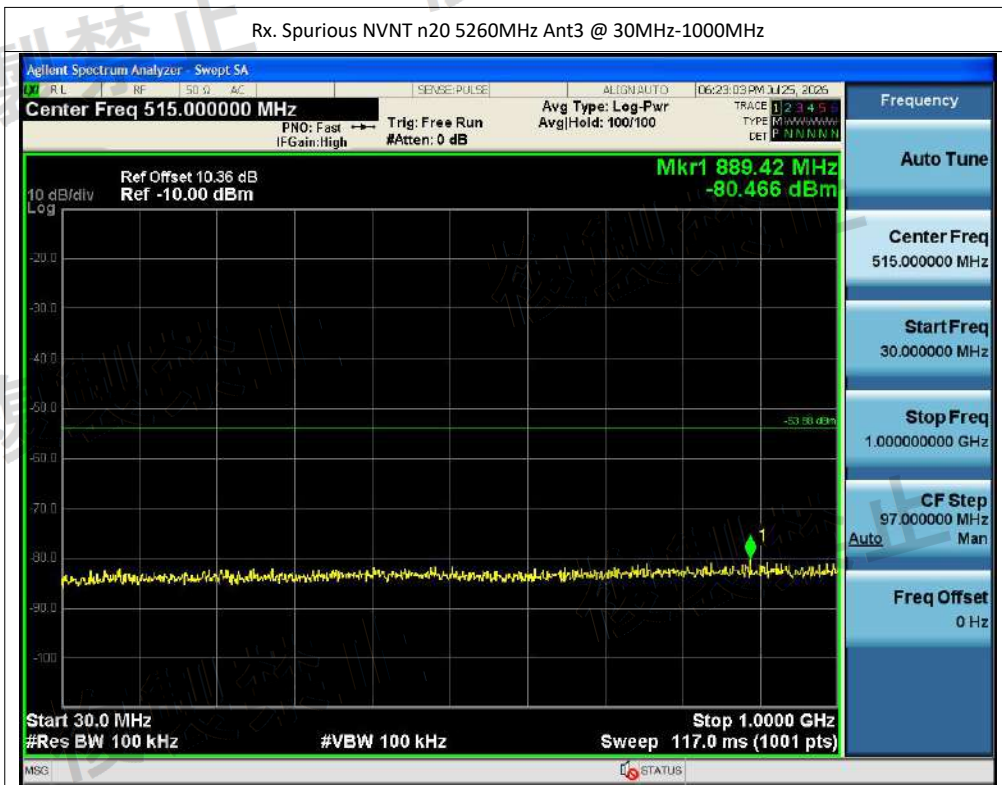



Rx. Spurious NVNT n20 5260MHz Ant3 @ 1000MHz-26000MHz




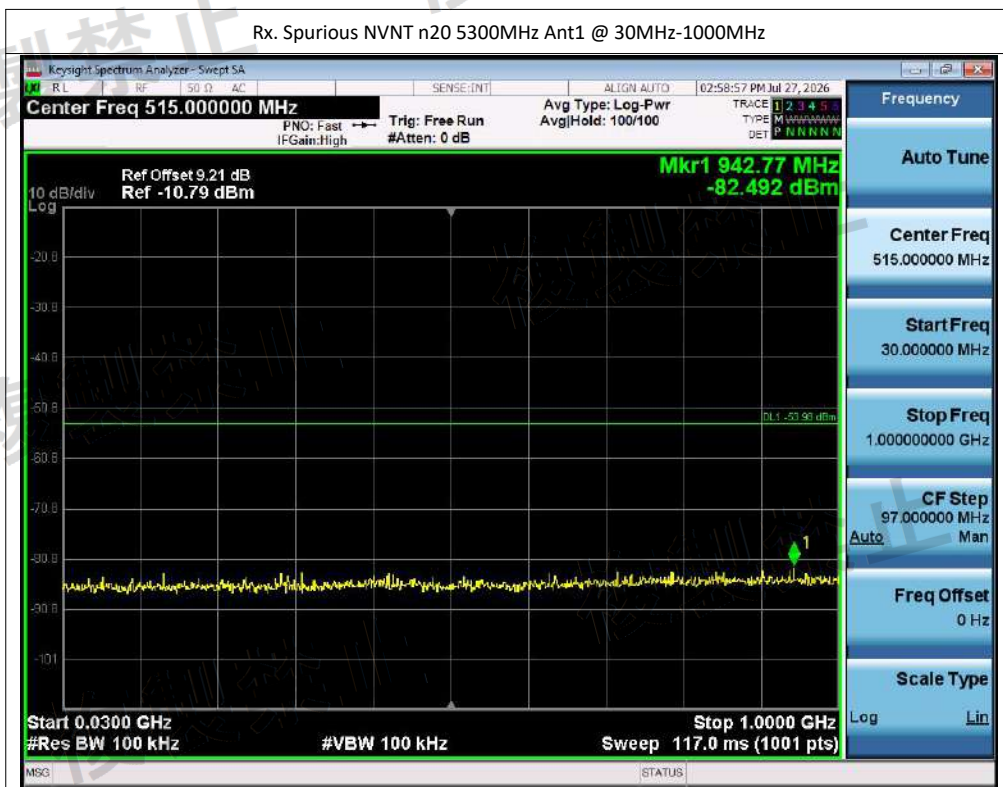


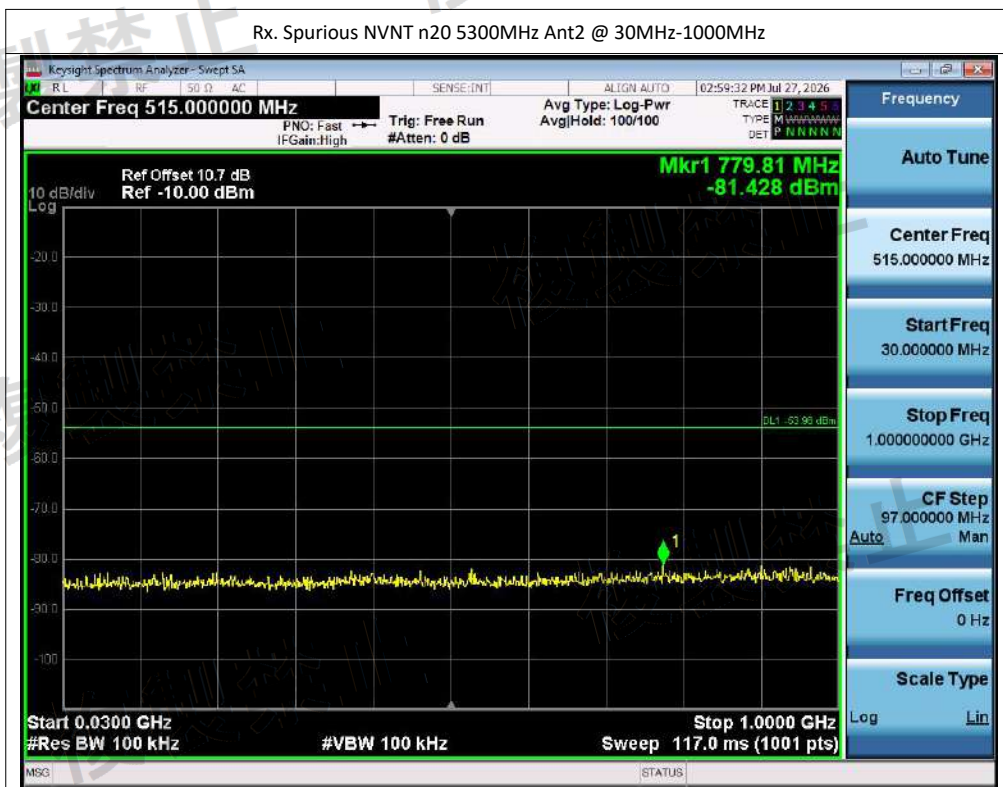


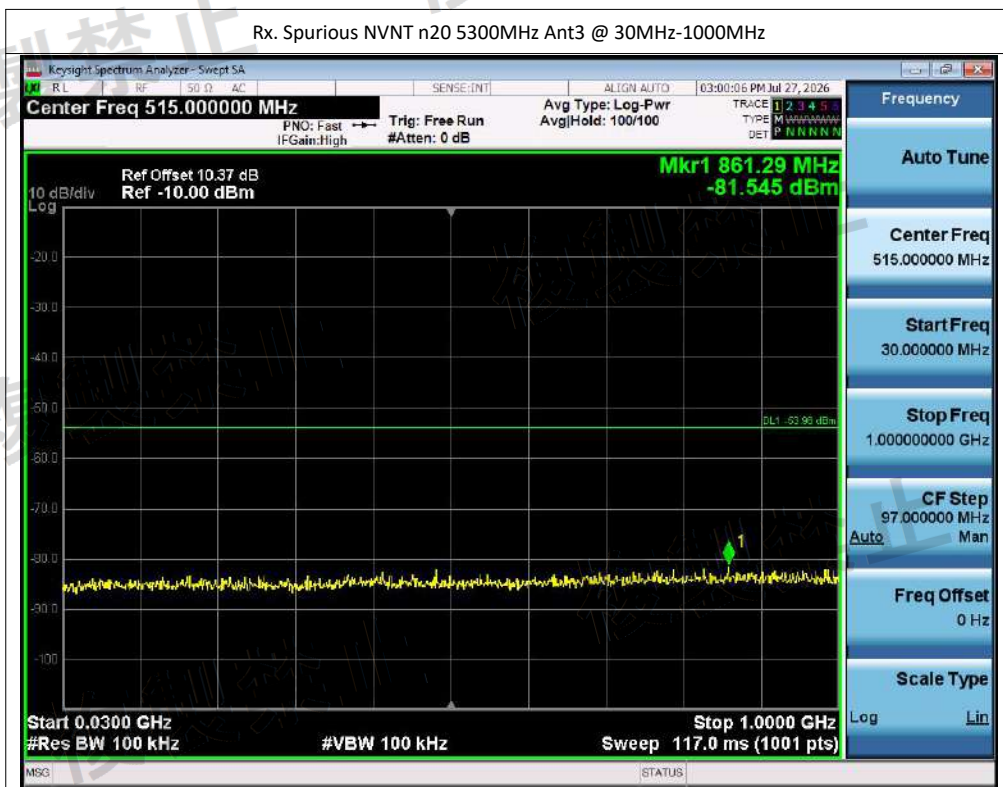


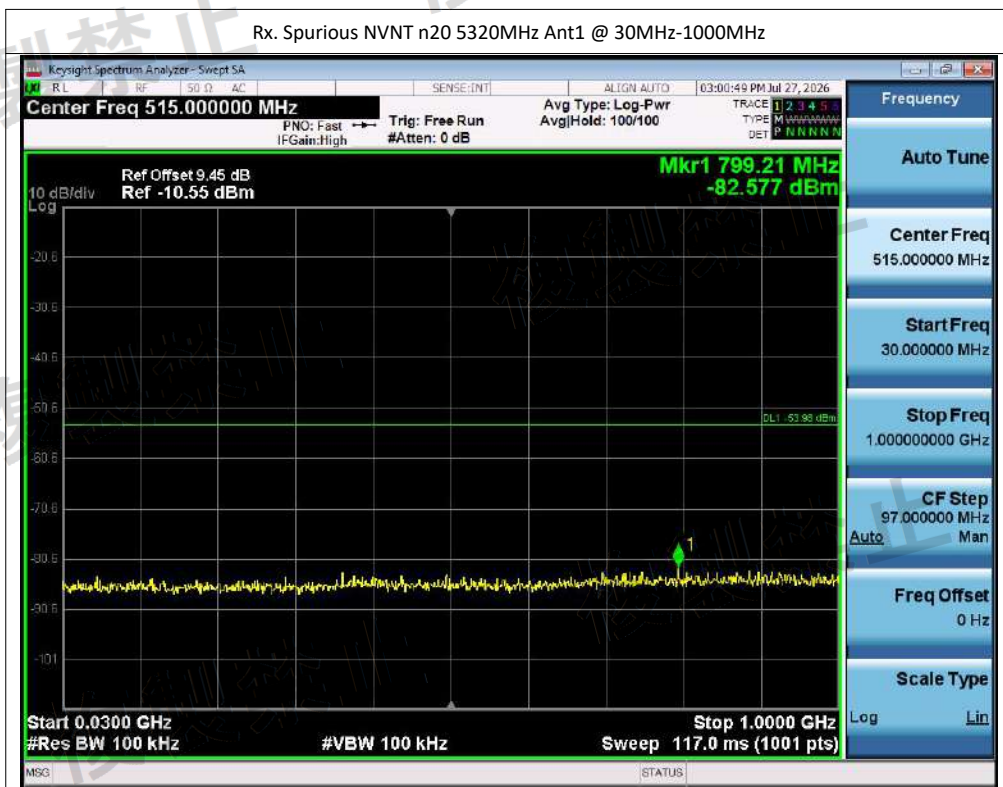


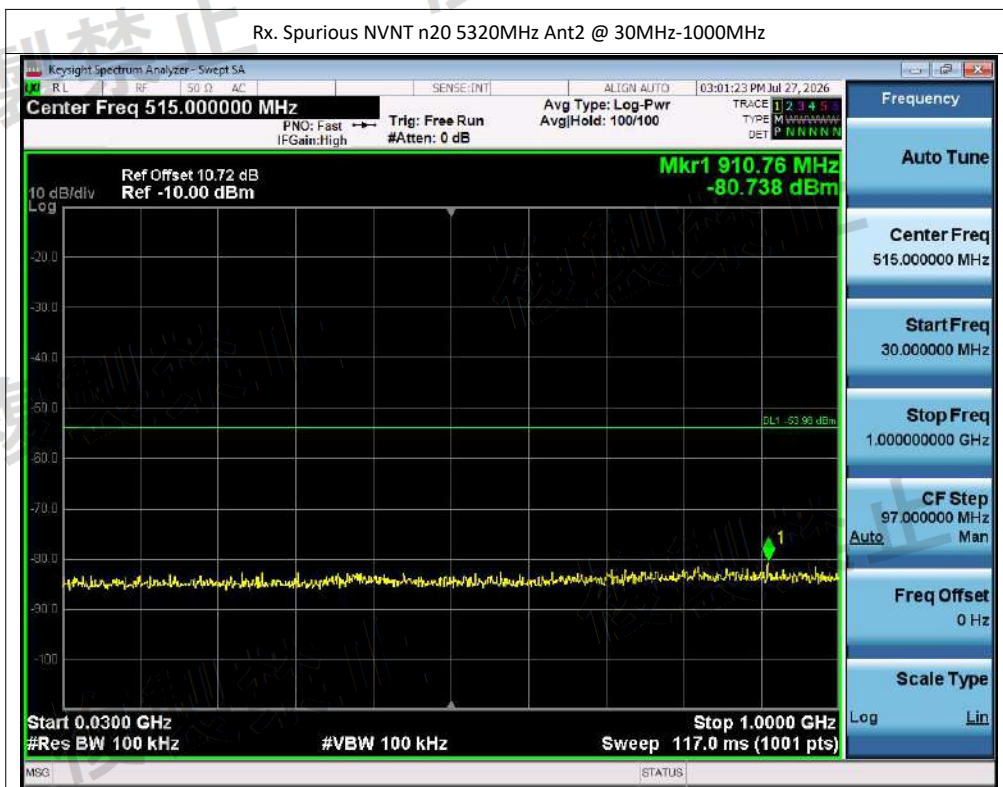


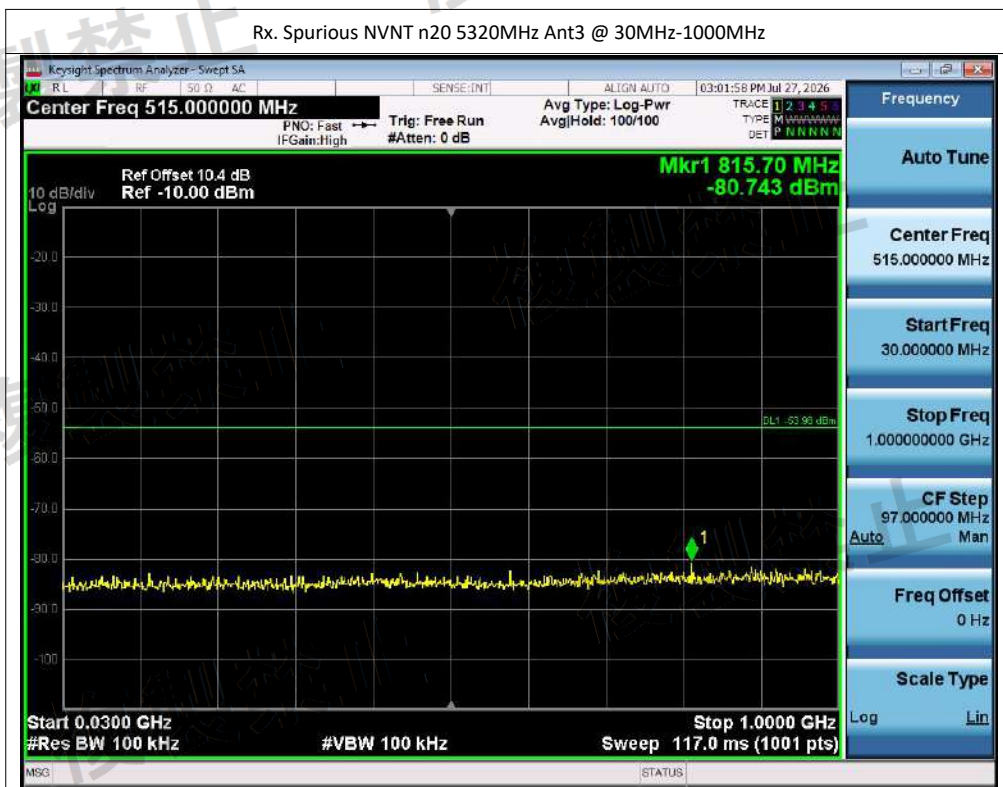


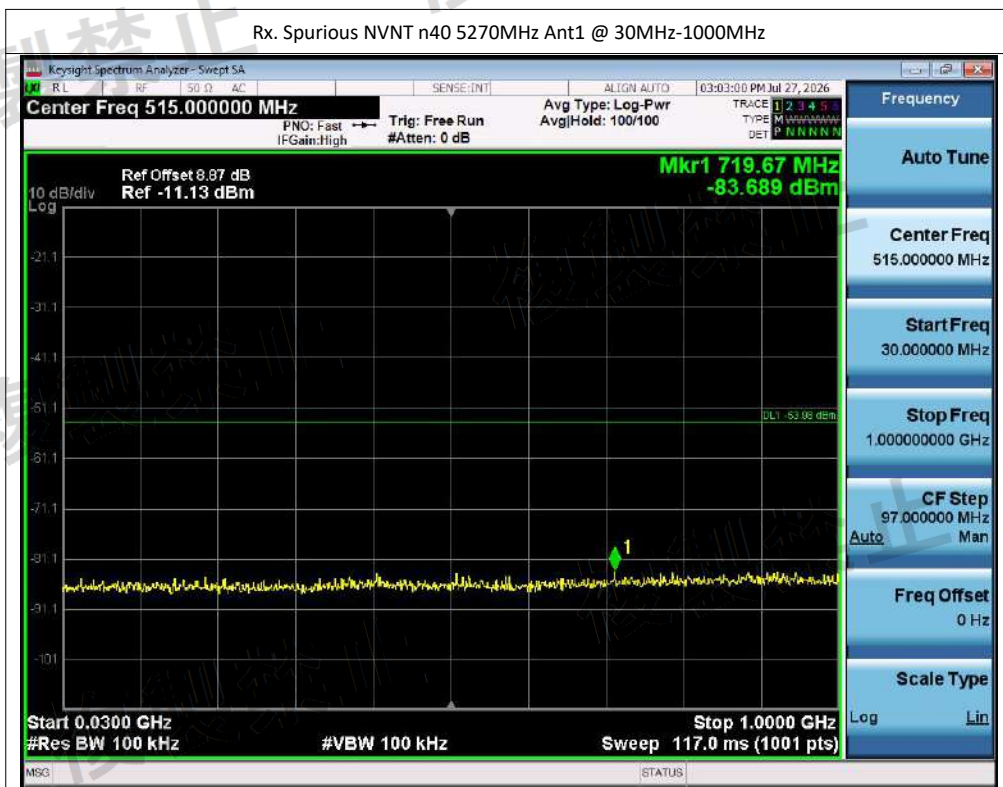


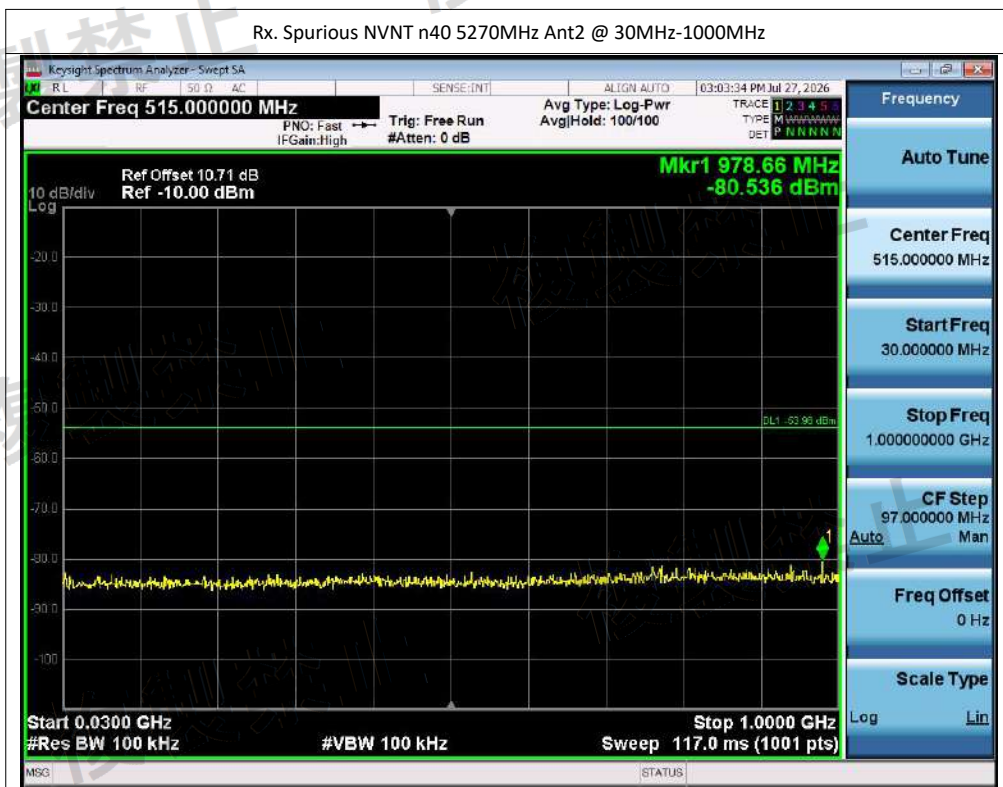

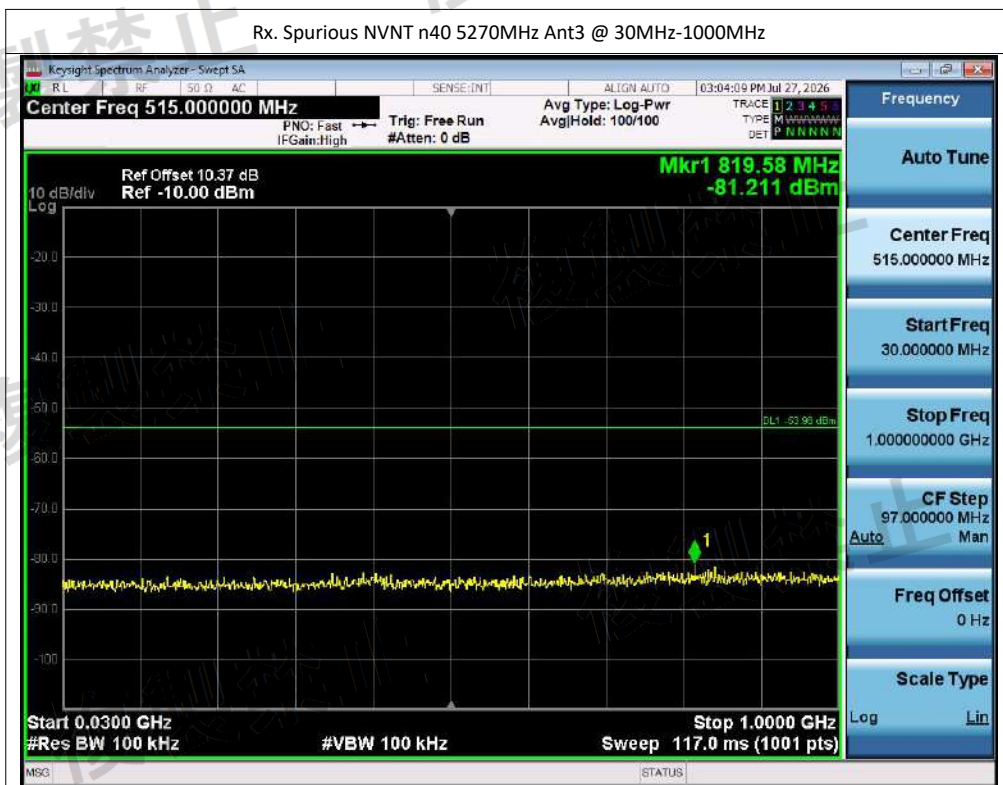

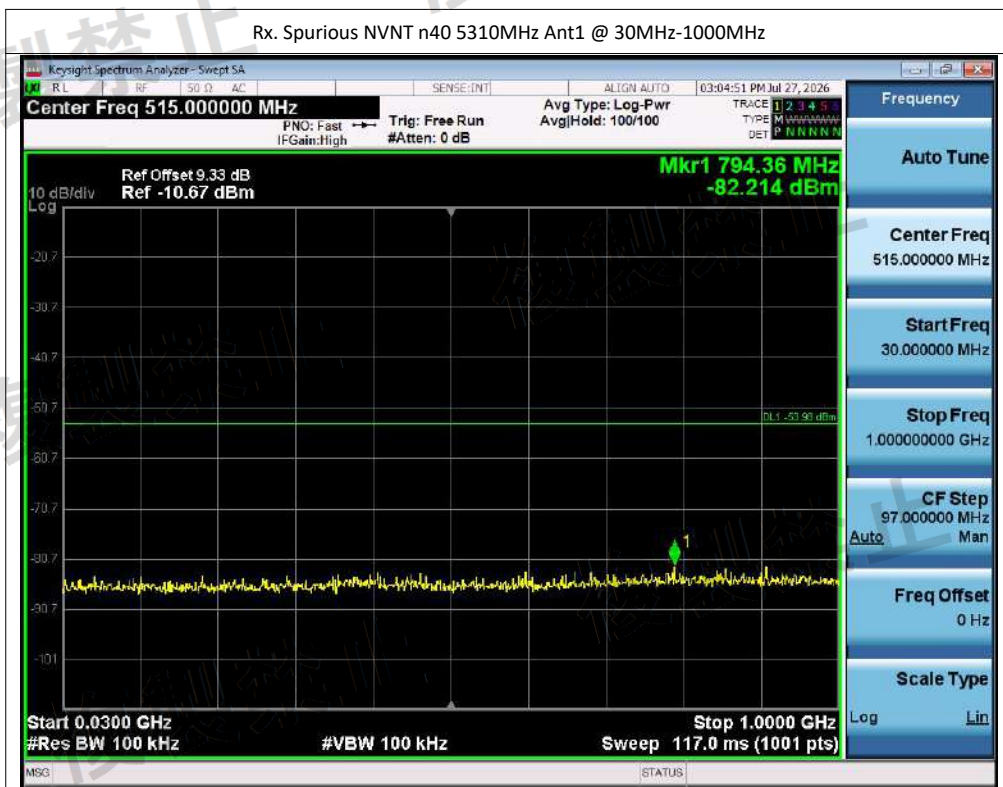

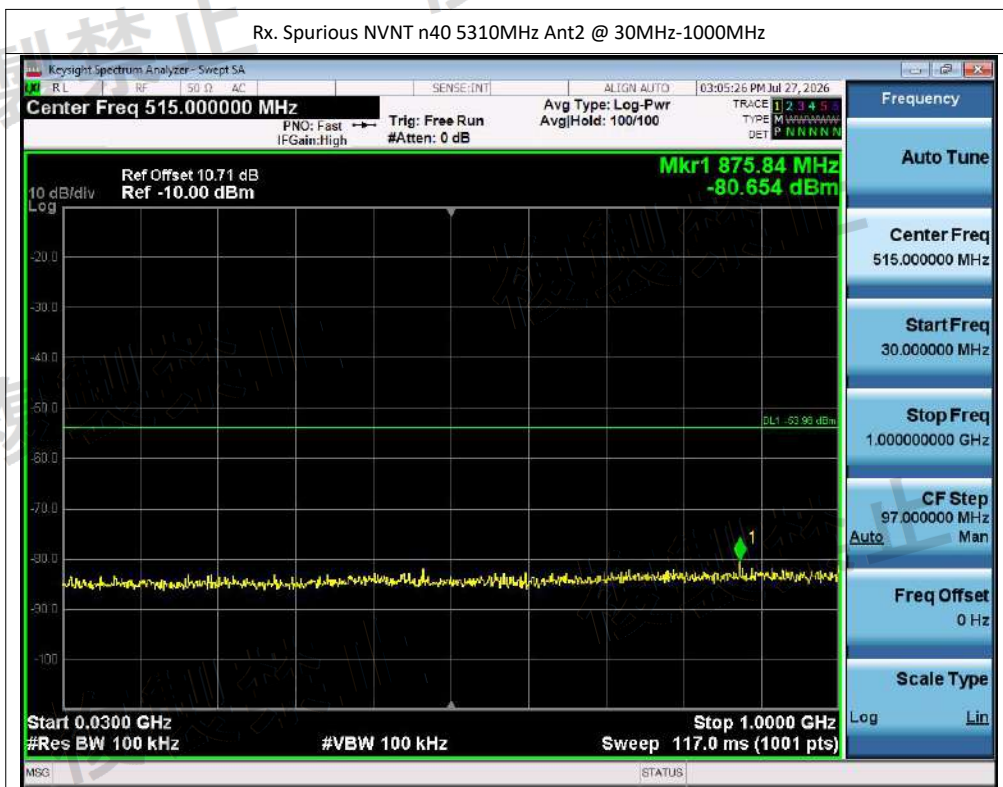

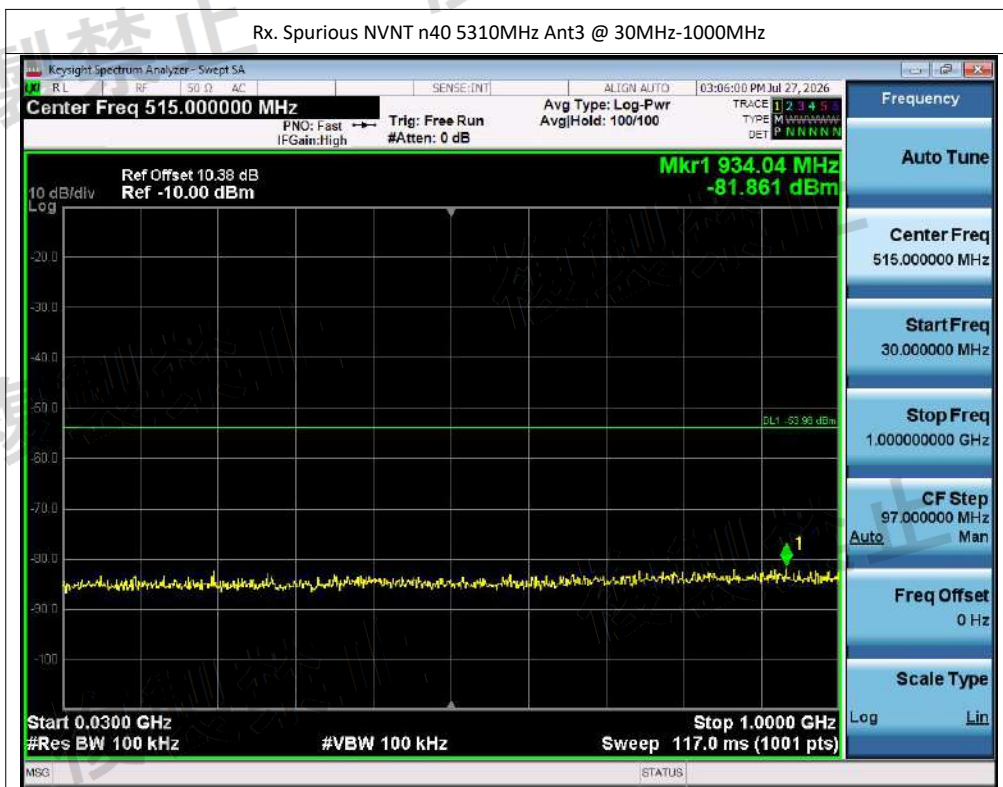

Adjacent Channel Emitted Power

Condition	Mode	Frequency (MHz)	Antenna	Offset (MHz)	Value (dBc)	Limit (dBc)	Verdict
NVNT	a	5260	Ant1	-20	-33.11	-25	Pass
NVNT	a	5260	Ant1	-40	-46.82	-40	Pass
NVNT	a	5260	Ant1	20	-33.65	-25	Pass
NVNT	a	5260	Ant1	40	-47.07	-40	Pass
NVNT	a	5300	Ant1	-20	-27	-25	Pass
NVNT	a	5300	Ant1	-40	-46.88	-40	Pass
NVNT	a	5300	Ant1	20	-26.8	-25	Pass
NVNT	a	5300	Ant1	40	-47.48	-40	Pass
NVNT	a	5320	Ant1	-20	-26.32	-25	Pass
NVNT	a	5320	Ant1	-40	-46.35	-40	Pass
NVNT	a	5320	Ant1	20	-27.99	-25	Pass
NVNT	a	5320	Ant1	40	-46.59	-40	Pass
NVNT	a	5260	Ant2	-20	-33.04	-25	Pass
NVNT	a	5260	Ant2	-40	-47.48	-40	Pass
NVNT	a	5260	Ant2	20	-33.67	-25	Pass
NVNT	a	5260	Ant2	40	-47.4	-40	Pass
NVNT	a	5300	Ant2	-20	-27.11	-25	Pass
NVNT	a	5300	Ant2	-40	-47.88	-40	Pass
NVNT	a	5300	Ant2	20	-26.57	-25	Pass
NVNT	a	5300	Ant2	40	-48.35	-40	Pass
NVNT	a	5320	Ant2	-20	-25.8	-25	Pass
NVNT	a	5320	Ant2	-40	-47.34	-40	Pass
NVNT	a	5320	Ant2	20	-28.5	-25	Pass
NVNT	a	5320	Ant2	40	-47.74	-40	Pass
NVNT	a	5260	Ant3	-20	-32.67	-25	Pass
NVNT	a	5260	Ant3	-40	-46.87	-40	Pass
NVNT	a	5260	Ant3	20	-33.88	-25	Pass
NVNT	a	5260	Ant3	40	-46.95	-40	Pass
NVNT	a	5300	Ant3	-20	-27.5	-25	Pass
NVNT	a	5300	Ant3	-40	-46.86	-40	Pass
NVNT	a	5300	Ant3	20	-27.14	-25	Pass
NVNT	a	5300	Ant3	40	-47.24	-40	Pass
NVNT	a	5320	Ant3	-20	-25.83	-25	Pass
NVNT	a	5320	Ant3	-40	-45.64	-40	Pass
NVNT	a	5320	Ant3	20	-28.41	-25	Pass
NVNT	a	5320	Ant3	40	-46.02	-40	Pass
NVNT	ac20	5260	Ant1	-20	-32.38	-25	Pass
NVNT	ac20	5260	Ant1	-40	-46.77	-40	Pass
NVNT	ac20	5260	Ant1	20	-33.01	-25	Pass

NVNT	ac20	5260	Ant1	40	-46.98	-40	Pass
NVNT	ac20	5260	Ant2	-20	-32.3	-25	Pass
NVNT	ac20	5260	Ant2	-40	-47.09	-40	Pass
NVNT	ac20	5260	Ant2	20	-32.93	-25	Pass
NVNT	ac20	5260	Ant2	40	-47.31	-40	Pass
NVNT	ac20	5260	Ant3	-20	-32.46	-25	Pass
NVNT	ac20	5260	Ant3	-40	-46.47	-40	Pass
NVNT	ac20	5260	Ant3	20	-32.91	-25	Pass
NVNT	ac20	5260	Ant3	40	-46.45	-40	Pass
NVNT	ac20	5300	Ant1	-20	-26.06	-25	Pass
NVNT	ac20	5300	Ant1	-40	-47.05	-40	Pass
NVNT	ac20	5300	Ant1	20	-25.82	-25	Pass
NVNT	ac20	5300	Ant1	40	-47.59	-40	Pass
NVNT	ac20	5300	Ant2	-20	-26.29	-25	Pass
NVNT	ac20	5300	Ant2	-40	-47.69	-40	Pass
NVNT	ac20	5300	Ant2	20	-25.81	-25	Pass
NVNT	ac20	5300	Ant2	40	-48.16	-40	Pass
NVNT	ac20	5300	Ant3	-20	-26.36	-25	Pass
NVNT	ac20	5300	Ant3	-40	-47.77	-40	Pass
NVNT	ac20	5300	Ant3	20	-26.14	-25	Pass
NVNT	ac20	5300	Ant3	40	-48.28	-40	Pass
NVNT	ac20	5320	Ant1	-20	-25.1	-25	Pass
NVNT	ac20	5320	Ant1	-40	-45.41	-40	Pass
NVNT	ac20	5320	Ant1	20	-27.18	-25	Pass
NVNT	ac20	5320	Ant1	40	-45.72	-40	Pass
NVNT	ac20	5320	Ant2	-20	-25.14	-25	Pass
NVNT	ac20	5320	Ant2	-40	-45.98	-40	Pass
NVNT	ac20	5320	Ant2	20	-27.5	-25	Pass
NVNT	ac20	5320	Ant2	40	-46.38	-40	Pass
NVNT	ac20	5320	Ant3	-20	-25.22	-25	Pass
NVNT	ac20	5320	Ant3	-40	-45.59	-40	Pass
NVNT	ac20	5320	Ant3	20	-27.48	-25	Pass
NVNT	ac20	5320	Ant3	40	-46.02	-40	Pass
NVNT	ac40	5270	Ant1	-40	-37.3	-25	Pass
NVNT	ac40	5270	Ant1	-80	-43.18	-40	Pass
NVNT	ac40	5270	Ant1	40	-38.61	-25	Pass
NVNT	ac40	5270	Ant1	80	-43.29	-40	Pass
NVNT	ac40	5270	Ant2	-40	-37.87	-25	Pass
NVNT	ac40	5270	Ant2	-80	-43.75	-40	Pass
NVNT	ac40	5270	Ant2	40	-38.97	-25	Pass
NVNT	ac40	5270	Ant2	80	-43.74	-40	Pass
NVNT	ac40	5270	Ant3	-40	-37.85	-25	Pass

NVNT	ac40	5270	Ant3	-80	-42.89	-40	Pass
NVNT	ac40	5270	Ant3	40	-38.08	-25	Pass
NVNT	ac40	5270	Ant3	80	-42.93	-40	Pass
NVNT	ac40	5310	Ant1	-40	-27.86	-25	Pass
NVNT	ac40	5310	Ant1	-80	-42.34	-40	Pass
NVNT	ac40	5310	Ant1	40	-30.36	-25	Pass
NVNT	ac40	5310	Ant1	80	-42.58	-40	Pass
NVNT	ac40	5310	Ant2	-40	-27.93	-25	Pass
NVNT	ac40	5310	Ant2	-80	-43.14	-40	Pass
NVNT	ac40	5310	Ant2	40	-30.62	-25	Pass
NVNT	ac40	5310	Ant2	80	-43.24	-40	Pass
NVNT	ac40	5310	Ant3	-40	-28.05	-25	Pass
NVNT	ac40	5310	Ant3	-80	-42.79	-40	Pass
NVNT	ac40	5310	Ant3	40	-31.06	-25	Pass
NVNT	ac40	5310	Ant3	80	-42.85	-40	Pass
NVNT	ac80	5290	Ant1	-80	-27.58	-25	Pass
NVNT	ac80	5290	Ant1	-160	-40.86	-40	Pass
NVNT	ac80	5290	Ant1	80	-32.54	-25	Pass
NVNT	ac80	5290	Ant1	160	-40.35	-40	Pass
NVNT	ac80	5290	Ant2	-80	-27.74	-25	Pass
NVNT	ac80	5290	Ant2	-160	-41.39	-40	Pass
NVNT	ac80	5290	Ant2	80	-32.52	-25	Pass
NVNT	ac80	5290	Ant2	160	-40.89	-40	Pass
NVNT	ac80	5290	Ant3	-80	-28	-25	Pass
NVNT	ac80	5290	Ant3	-160	-40.88	-40	Pass
NVNT	ac80	5290	Ant3	80	-32.57	-25	Pass
NVNT	ac80	5290	Ant3	160	-40.45	-40	Pass
NVNT	ax20	5260	Ant1	-20	-29.92	-25	Pass
NVNT	ax20	5260	Ant1	-40	-48.06	-40	Pass
NVNT	ax20	5260	Ant1	20	-30.73	-25	Pass
NVNT	ax20	5260	Ant1	40	-48.12	-40	Pass
NVNT	ax20	5260	Ant2	-20	-30.09	-25	Pass
NVNT	ax20	5260	Ant2	-40	-48.58	-40	Pass
NVNT	ax20	5260	Ant2	20	-30.74	-25	Pass
NVNT	ax20	5260	Ant2	40	-48.58	-40	Pass
NVNT	ax20	5260	Ant3	-20	-30.18	-25	Pass
NVNT	ax20	5260	Ant3	-40	-47.88	-40	Pass
NVNT	ax20	5260	Ant3	20	-30.39	-25	Pass
NVNT	ax20	5260	Ant3	40	-47.73	-40	Pass
NVNT	ax20	5300	Ant1	-20	-26.25	-25	Pass
NVNT	ax20	5300	Ant1	-40	-47.57	-40	Pass
NVNT	ax20	5300	Ant1	20	-25.78	-25	Pass


NVNT	ax20	5300	Ant1	40	-48.01	-40	Pass
NVNT	ax20	5300	Ant2	-20	-26.68	-25	Pass
NVNT	ax20	5300	Ant2	-40	-48.33	-40	Pass
NVNT	ax20	5300	Ant2	20	-26.47	-25	Pass
NVNT	ax20	5300	Ant2	40	-48.74	-40	Pass
NVNT	ax20	5300	Ant3	-20	-26.39	-25	Pass
NVNT	ax20	5300	Ant3	-40	-48.28	-40	Pass
NVNT	ax20	5300	Ant3	20	-26.1	-25	Pass
NVNT	ax20	5300	Ant3	40	-48.88	-40	Pass
NVNT	ax20	5320	Ant1	-20	-25.53	-25	Pass
NVNT	ax20	5320	Ant1	-40	-47.66	-40	Pass
NVNT	ax20	5320	Ant1	20	-27.21	-25	Pass
NVNT	ax20	5320	Ant1	40	-48.07	-40	Pass
NVNT	ax20	5320	Ant2	-20	-25.25	-25	Pass
NVNT	ax20	5320	Ant2	-40	-48.46	-40	Pass
NVNT	ax20	5320	Ant2	20	-27.42	-25	Pass
NVNT	ax20	5320	Ant2	40	-48.92	-40	Pass
NVNT	ax20	5320	Ant3	-20	-25.53	-25	Pass
NVNT	ax20	5320	Ant3	-40	-48.02	-40	Pass
NVNT	ax20	5320	Ant3	20	-28.04	-25	Pass
NVNT	ax20	5320	Ant3	40	-48.35	-40	Pass
NVNT	ax40	5270	Ant1	-40	-39.76	-25	Pass
NVNT	ax40	5270	Ant1	-80	-46.22	-40	Pass
NVNT	ax40	5270	Ant1	40	-41.46	-25	Pass
NVNT	ax40	5270	Ant1	80	-46.11	-40	Pass
NVNT	ax40	5270	Ant2	-40	-40.14	-25	Pass
NVNT	ax40	5270	Ant2	-80	-47.03	-40	Pass
NVNT	ax40	5270	Ant2	40	-41.77	-25	Pass
NVNT	ax40	5270	Ant2	80	-46.88	-40	Pass
NVNT	ax40	5270	Ant3	-40	-39.93	-25	Pass
NVNT	ax40	5270	Ant3	-80	-46.07	-40	Pass
NVNT	ax40	5270	Ant3	40	-41	-25	Pass
NVNT	ax40	5270	Ant3	80	-46.17	-40	Pass
NVNT	ax40	5310	Ant1	-40	-28.82	-25	Pass
NVNT	ax40	5310	Ant1	-80	-44.99	-40	Pass
NVNT	ax40	5310	Ant1	40	-32.45	-25	Pass
NVNT	ax40	5310	Ant1	80	-45.19	-40	Pass
NVNT	ax40	5310	Ant2	-40	-28.99	-25	Pass
NVNT	ax40	5310	Ant2	-80	-45.76	-40	Pass
NVNT	ax40	5310	Ant2	40	-32.47	-25	Pass
NVNT	ax40	5310	Ant2	80	-45.96	-40	Pass
NVNT	ax40	5310	Ant3	-40	-29.09	-25	Pass

NVNT	ax40	5310	Ant3	-80	-45.62	-40	Pass
NVNT	ax40	5310	Ant3	40	-32.84	-25	Pass
NVNT	ax40	5310	Ant3	80	-45.77	-40	Pass
NVNT	ax80	5290	Ant1	-80	-28.94	-25	Pass
NVNT	ax80	5290	Ant1	-160	-41.88	-40	Pass
NVNT	ax80	5290	Ant1	80	-33.94	-25	Pass
NVNT	ax80	5290	Ant1	160	-41.41	-40	Pass
NVNT	ax80	5290	Ant2	-80	-29.14	-25	Pass
NVNT	ax80	5290	Ant2	-160	-42.65	-40	Pass
NVNT	ax80	5290	Ant2	80	-33.9	-25	Pass
NVNT	ax80	5290	Ant2	160	-42.07	-40	Pass
NVNT	ax80	5290	Ant3	-80	-29.49	-25	Pass
NVNT	ax80	5290	Ant3	-160	-42.14	-40	Pass
NVNT	ax80	5290	Ant3	80	-34.35	-25	Pass
NVNT	ax80	5290	Ant3	160	-41.7	-40	Pass
NVNT	n20	5260	Ant1	-20	-31.42	-25	Pass
NVNT	n20	5260	Ant1	-40	-45.98	-40	Pass
NVNT	n20	5260	Ant1	20	-31.59	-25	Pass
NVNT	n20	5260	Ant1	40	-46.16	-40	Pass
NVNT	n20	5260	Ant2	-20	-31.22	-25	Pass
NVNT	n20	5260	Ant2	-40	-46.44	-40	Pass
NVNT	n20	5260	Ant2	20	-31.86	-25	Pass
NVNT	n20	5260	Ant2	40	-46.6	-40	Pass
NVNT	n20	5260	Ant3	-20	-31.32	-25	Pass
NVNT	n20	5260	Ant3	-40	-45.77	-40	Pass
NVNT	n20	5260	Ant3	20	-31.56	-25	Pass
NVNT	n20	5260	Ant3	40	-45.88	-40	Pass
NVNT	n20	5300	Ant1	-20	-26.33	-25	Pass
NVNT	n20	5300	Ant1	-40	-45.78	-40	Pass
NVNT	n20	5300	Ant1	20	-26.02	-25	Pass
NVNT	n20	5300	Ant1	40	-46.2	-40	Pass
NVNT	n20	5300	Ant2	-20	-26.6	-25	Pass
NVNT	n20	5300	Ant2	-40	-46.39	-40	Pass
NVNT	n20	5300	Ant2	20	-26.22	-25	Pass
NVNT	n20	5300	Ant2	40	-46.79	-40	Pass
NVNT	n20	5300	Ant3	-20	-26.56	-25	Pass
NVNT	n20	5300	Ant3	-40	-46.31	-40	Pass
NVNT	n20	5300	Ant3	20	-26.27	-25	Pass
NVNT	n20	5300	Ant3	40	-46.88	-40	Pass
NVNT	n20	5320	Ant1	-20	-25.27	-25	Pass
NVNT	n20	5320	Ant1	-40	-45.44	-40	Pass
NVNT	n20	5320	Ant1	20	-27.04	-25	Pass

NVNT	n20	5320	Ant1	40	-45.7	-40	Pass
NVNT	n20	5320	Ant2	-20	-25.33	-25	Pass
NVNT	n20	5320	Ant2	-40	-46.02	-40	Pass
NVNT	n20	5320	Ant2	20	-27.46	-25	Pass
NVNT	n20	5320	Ant2	40	-46.35	-40	Pass
NVNT	n20	5320	Ant3	-20	-25.21	-25	Pass
NVNT	n20	5320	Ant3	-40	-45.61	-40	Pass
NVNT	n20	5320	Ant3	20	-27.69	-25	Pass
NVNT	n20	5320	Ant3	40	-45.92	-40	Pass
NVNT	n40	5270	Ant1	-40	-37.49	-25	Pass
NVNT	n40	5270	Ant1	-80	-43.76	-40	Pass
NVNT	n40	5270	Ant1	40	-38.86	-25	Pass
NVNT	n40	5270	Ant1	80	-43.74	-40	Pass
NVNT	n40	5270	Ant2	-40	-37.36	-25	Pass
NVNT	n40	5270	Ant2	-80	-44.33	-40	Pass
NVNT	n40	5270	Ant2	40	-38.98	-25	Pass
NVNT	n40	5270	Ant2	80	-44.36	-40	Pass
NVNT	n40	5270	Ant3	-40	-37.68	-25	Pass
NVNT	n40	5270	Ant3	-80	-43.52	-40	Pass
NVNT	n40	5270	Ant3	40	-38.43	-25	Pass
NVNT	n40	5270	Ant3	80	-43.51	-40	Pass
NVNT	n40	5310	Ant1	-40	-28.12	-25	Pass
NVNT	n40	5310	Ant1	-80	-42.41	-40	Pass
NVNT	n40	5310	Ant1	40	-31.16	-25	Pass
NVNT	n40	5310	Ant1	80	-42.74	-40	Pass
NVNT	n40	5310	Ant2	-40	-28.03	-25	Pass
NVNT	n40	5310	Ant2	-80	-43.02	-40	Pass
NVNT	n40	5310	Ant2	40	-31.19	-25	Pass
NVNT	n40	5310	Ant2	80	-43.35	-40	Pass
NVNT	n40	5310	Ant3	-40	-28.43	-25	Pass
NVNT	n40	5310	Ant3	-80	-42.88	-40	Pass
NVNT	n40	5310	Ant3	40	-31.77	-25	Pass
NVNT	n40	5310	Ant3	80	-43	-40	Pass



Test Graphs


ACEP NVNT a 5260MHz Ant1

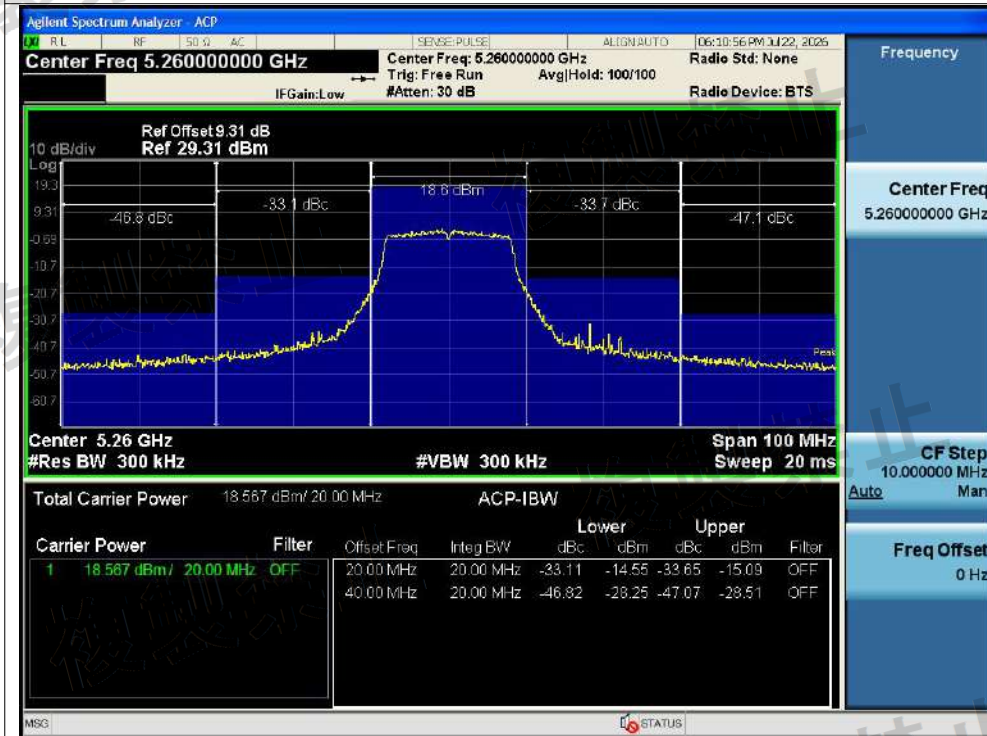




ACEP NVNT a 5300MHz Ant1





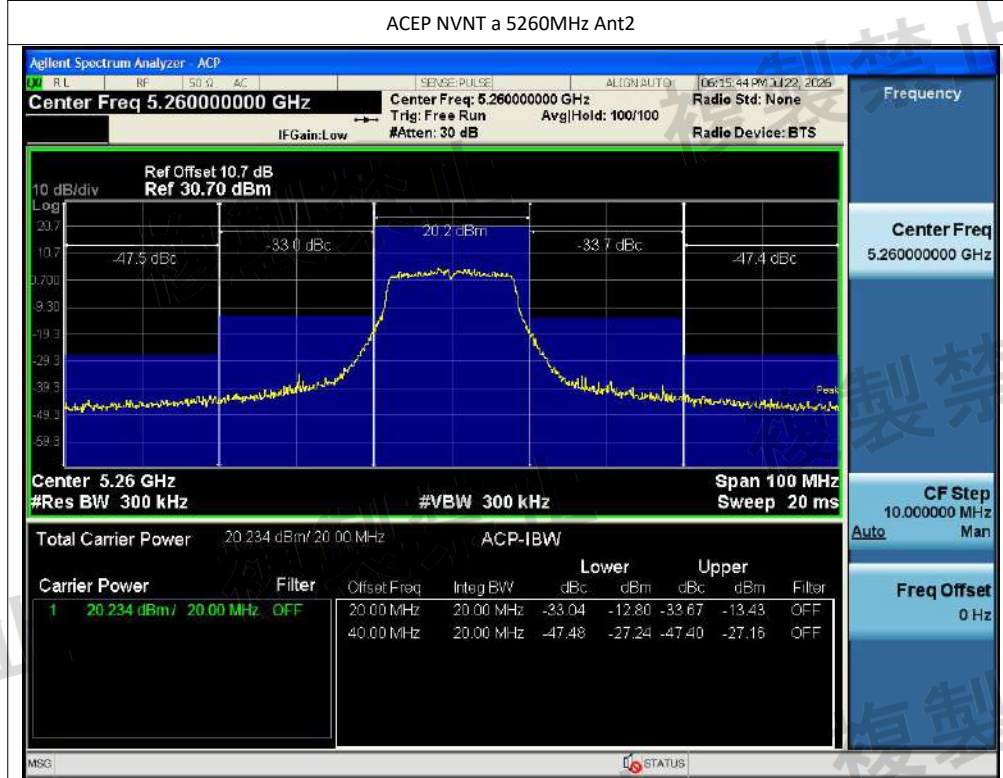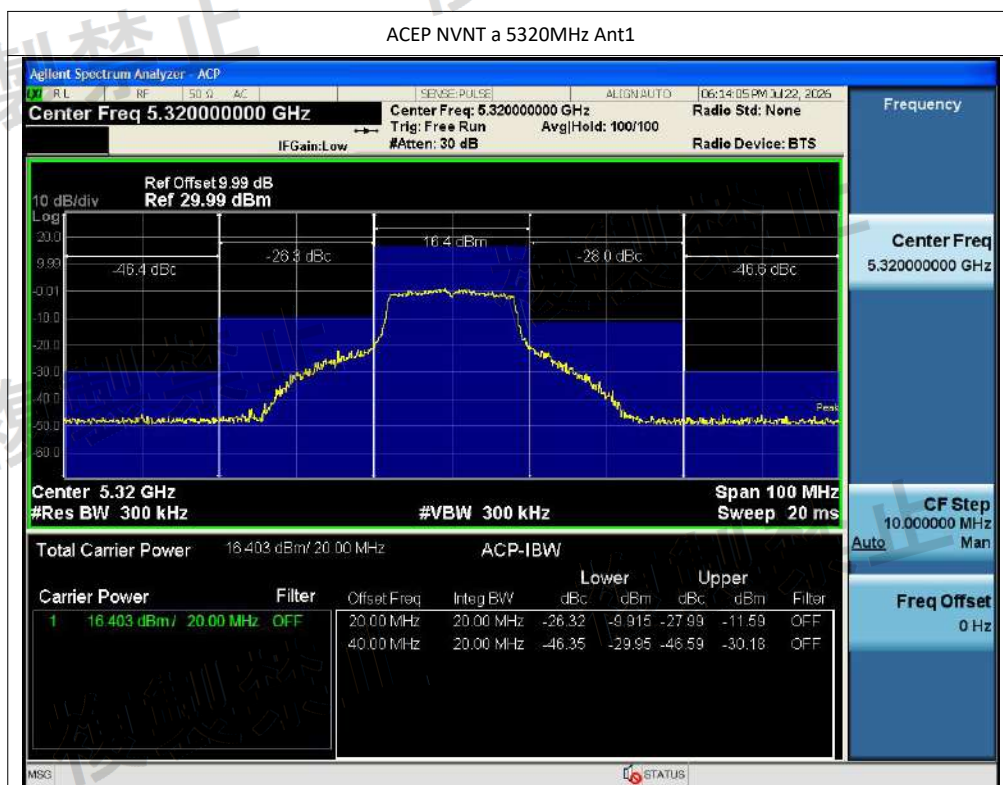


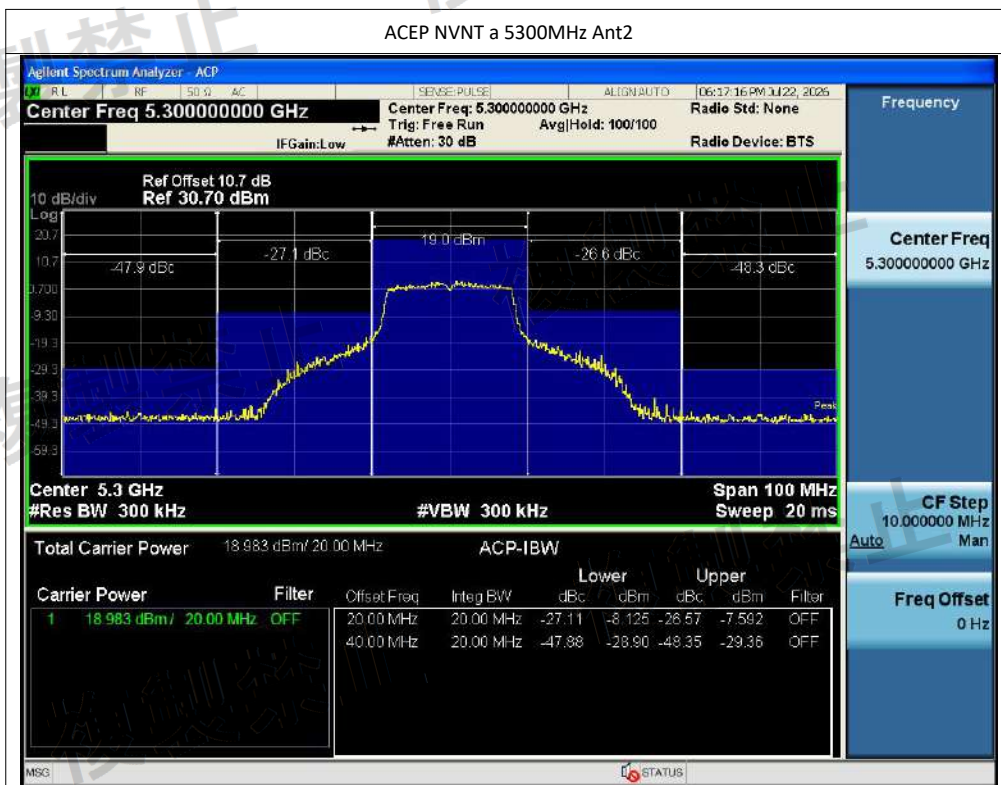


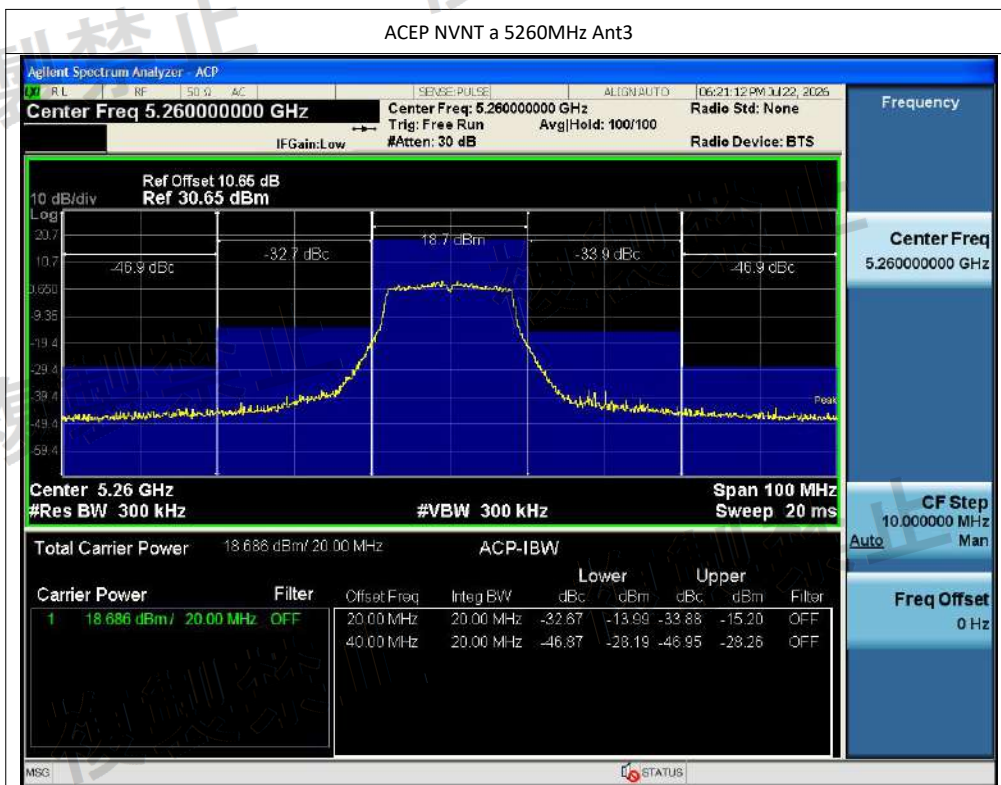


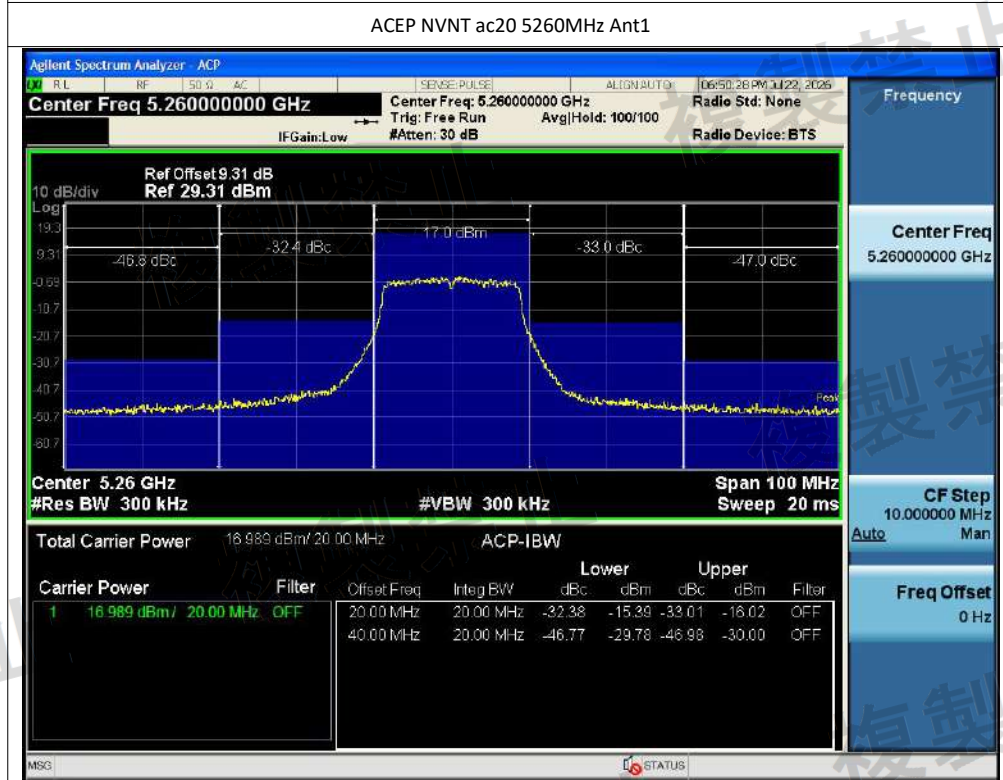
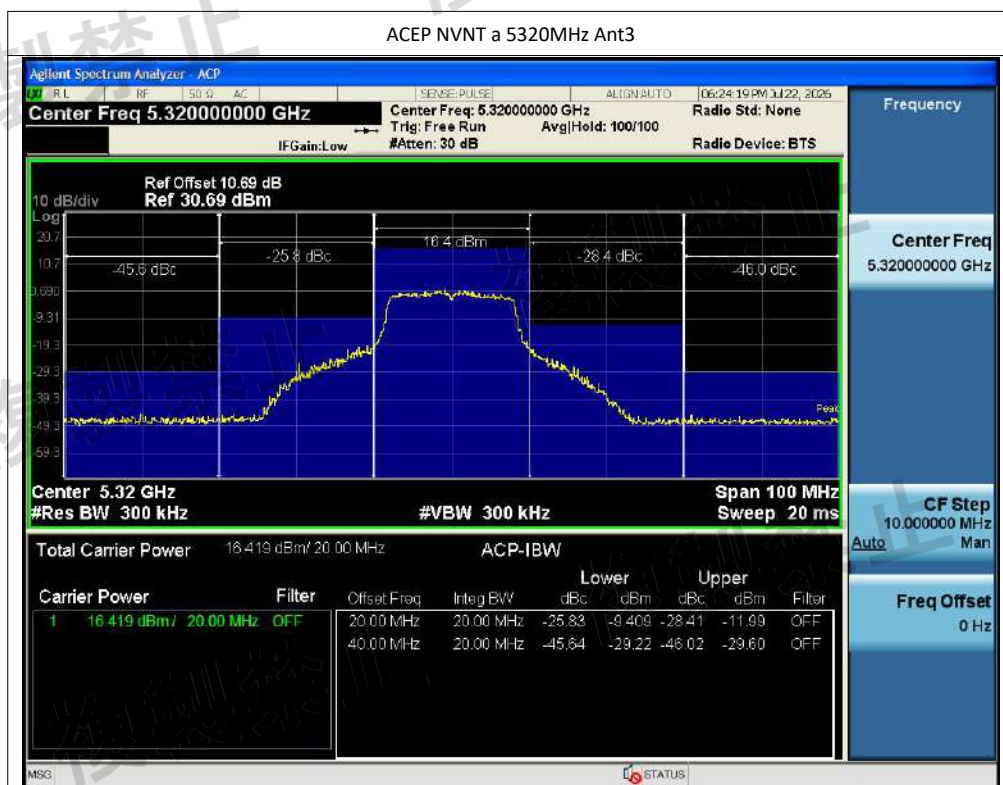


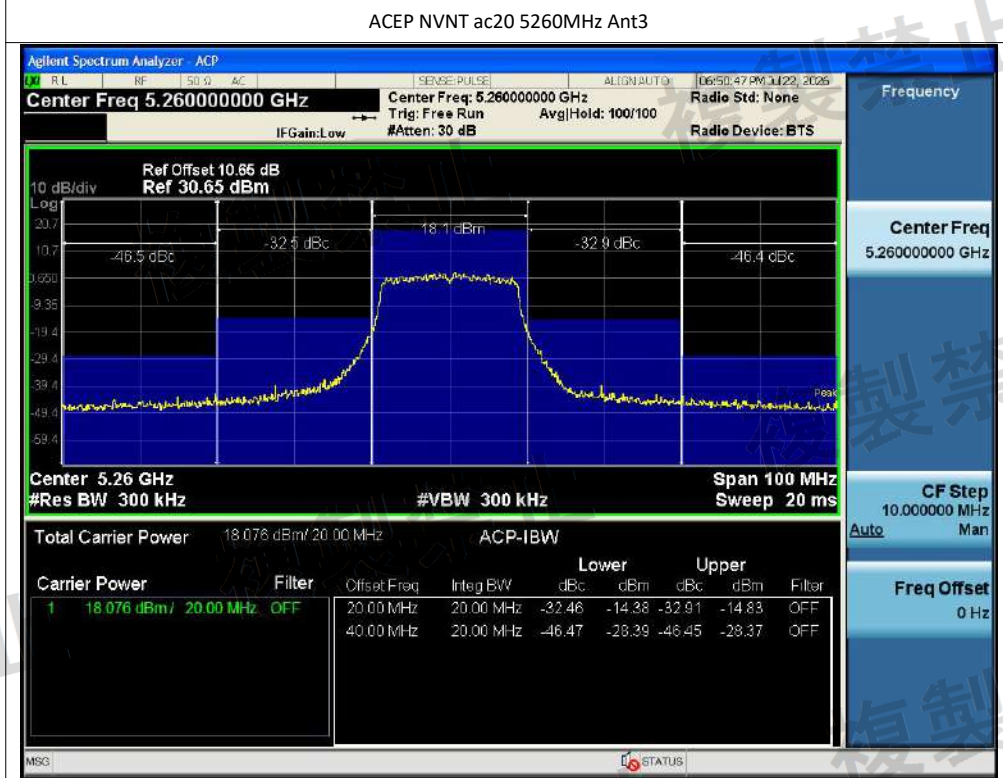
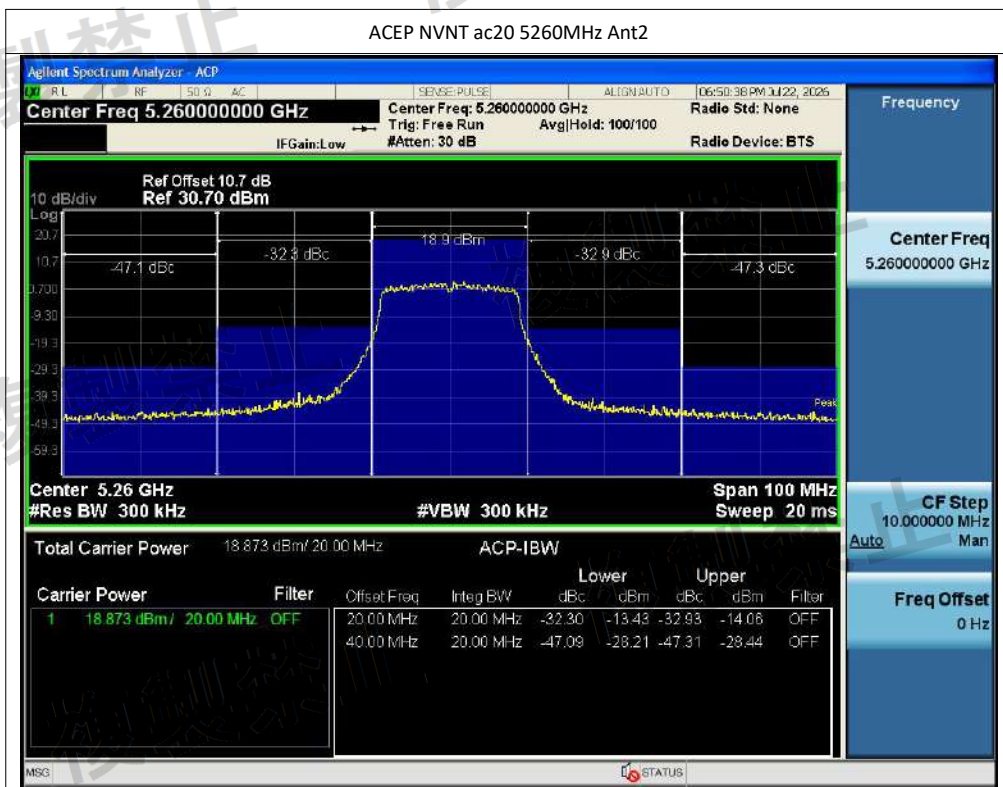



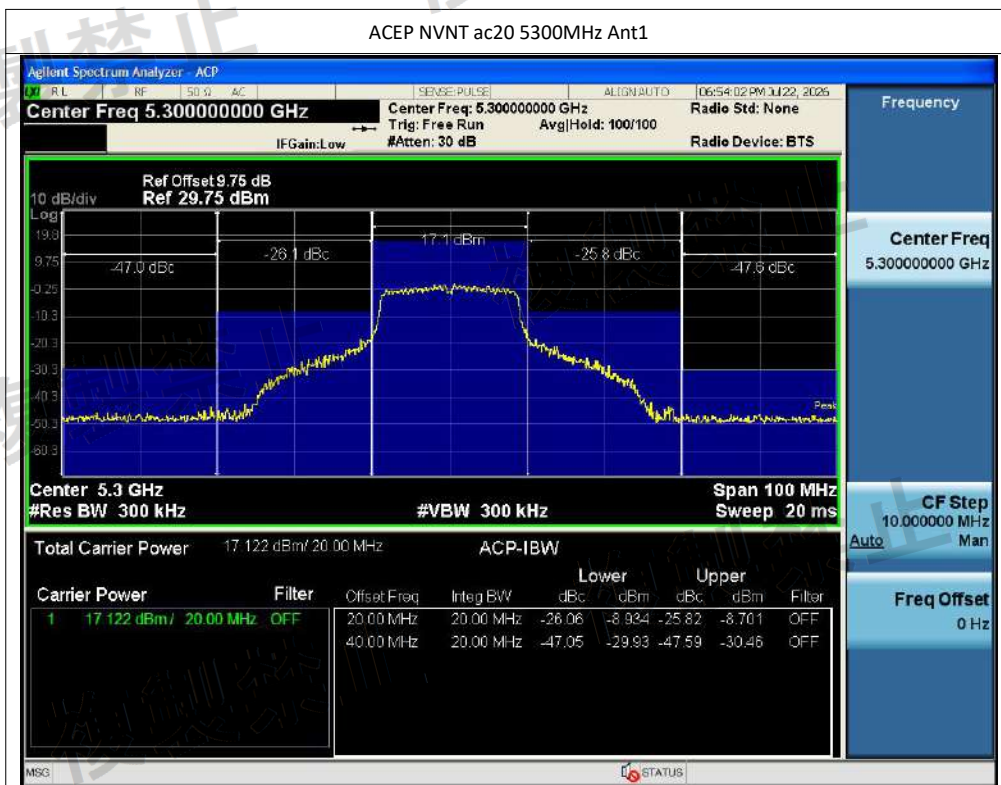



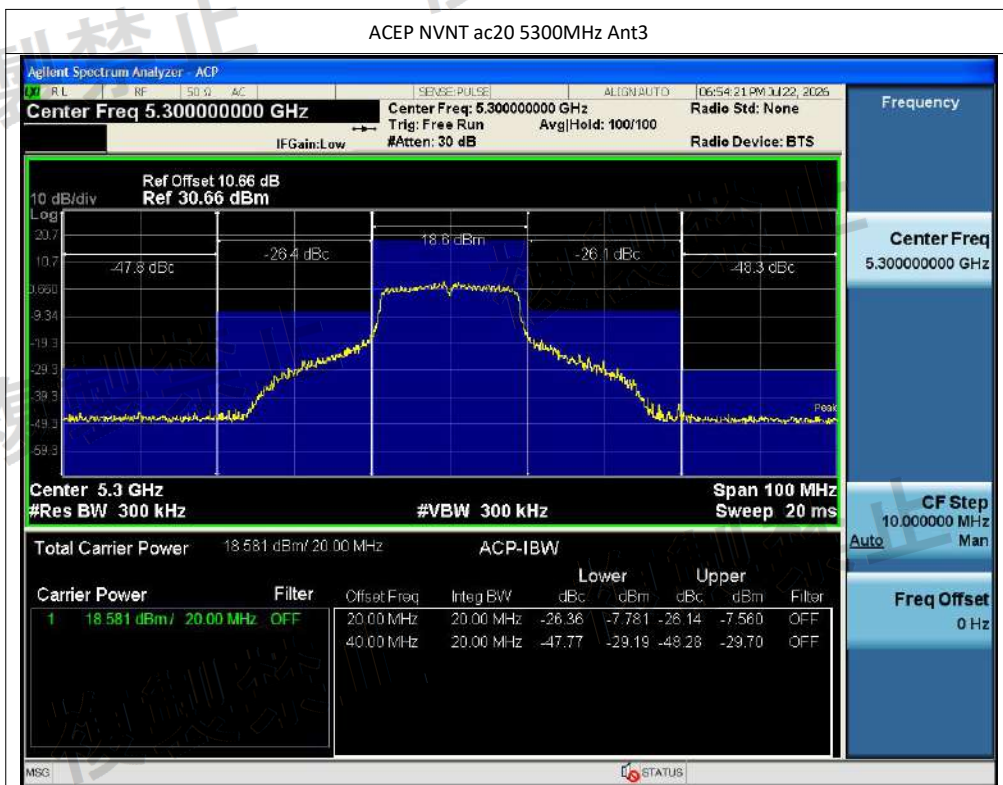


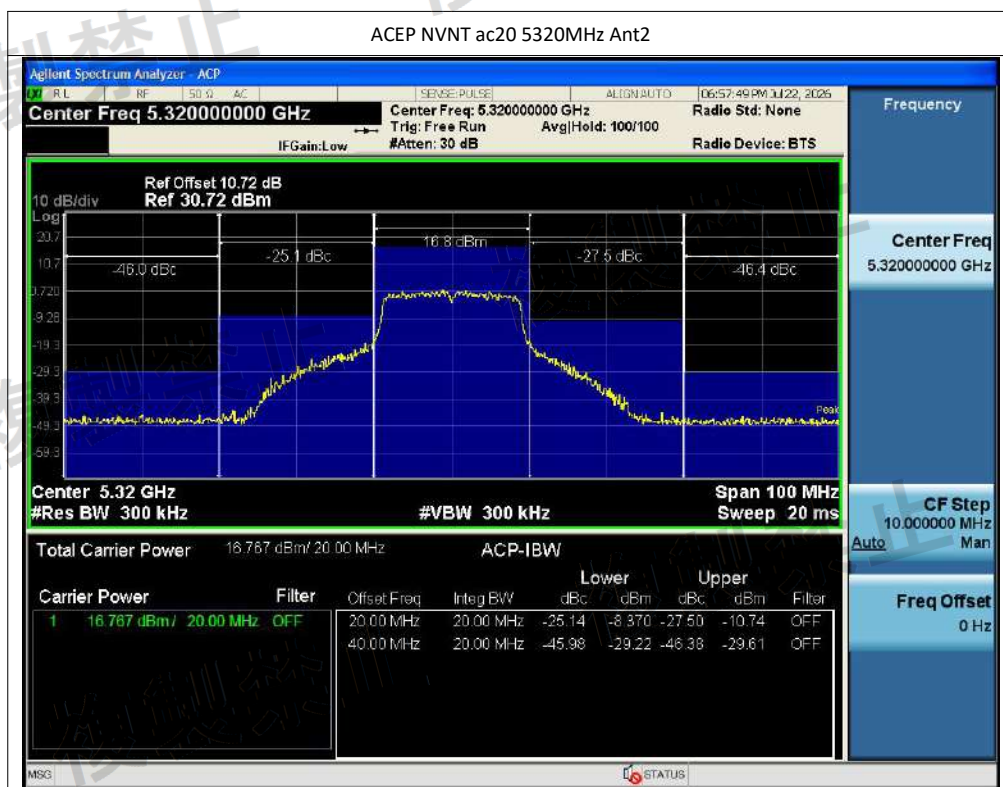


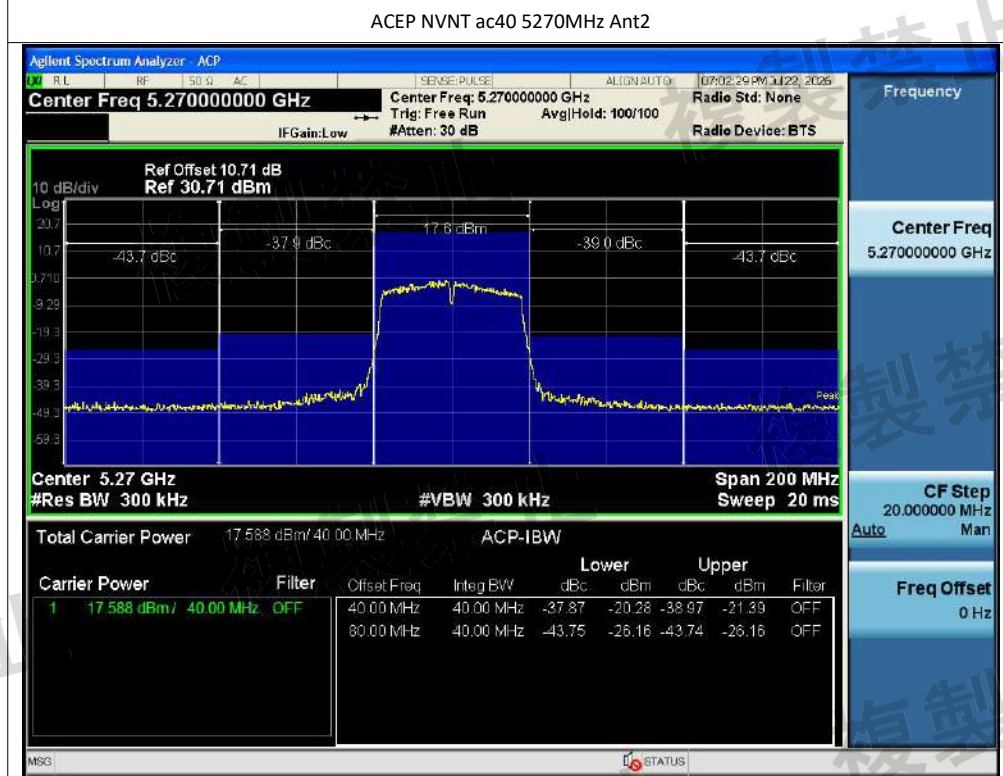
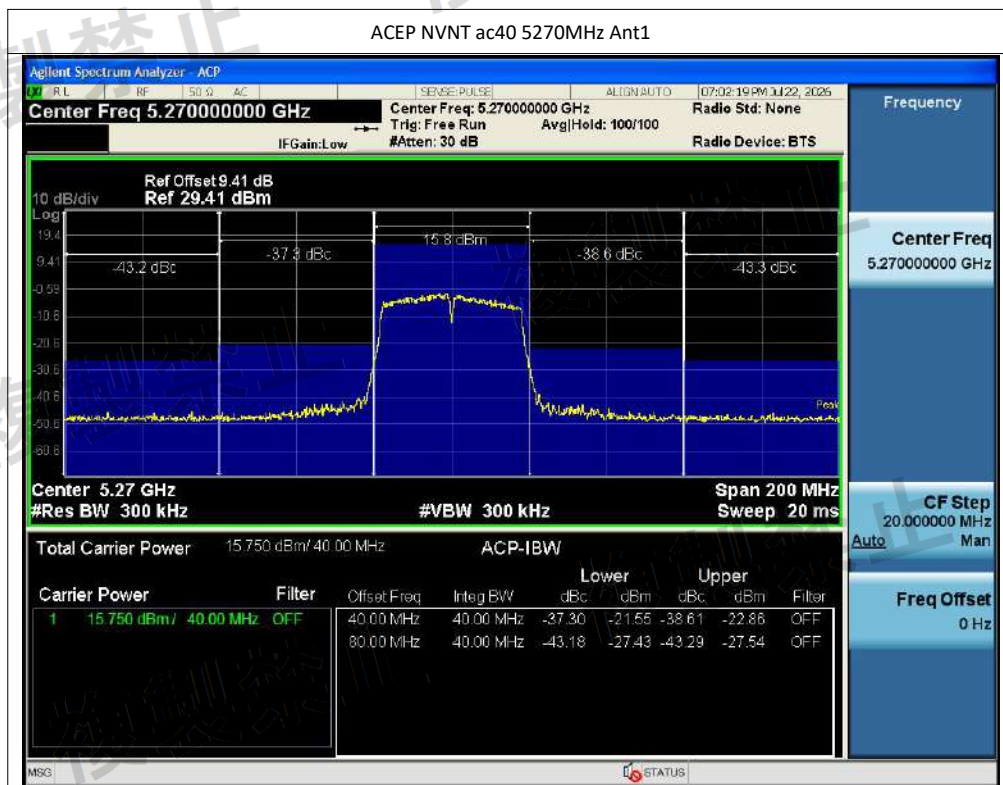


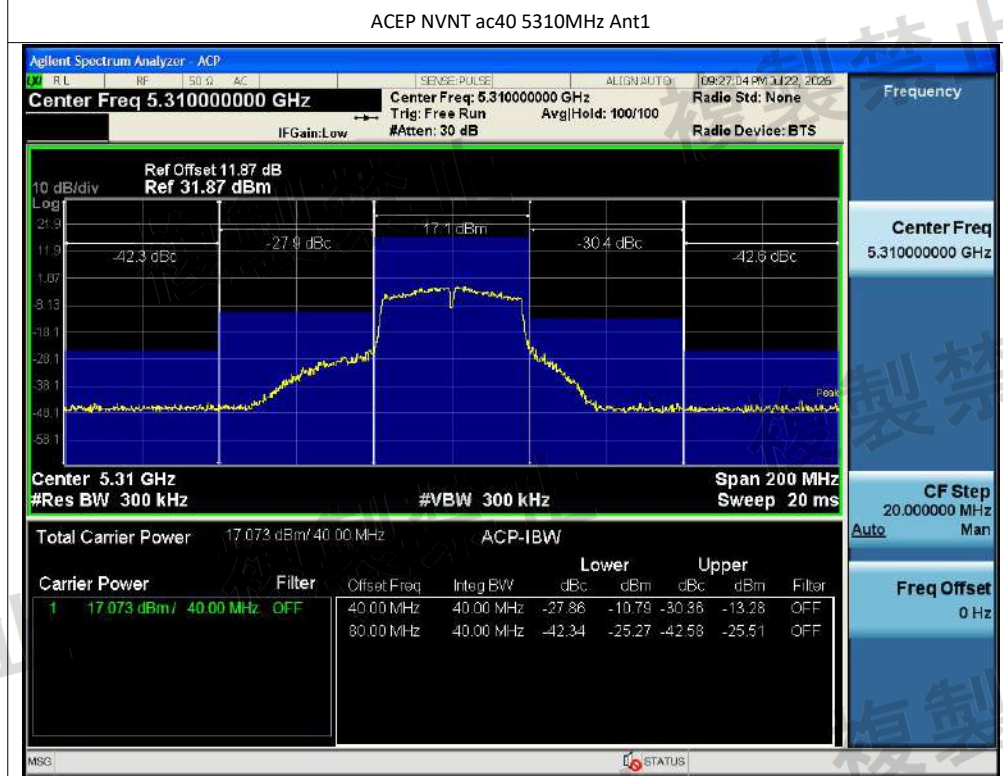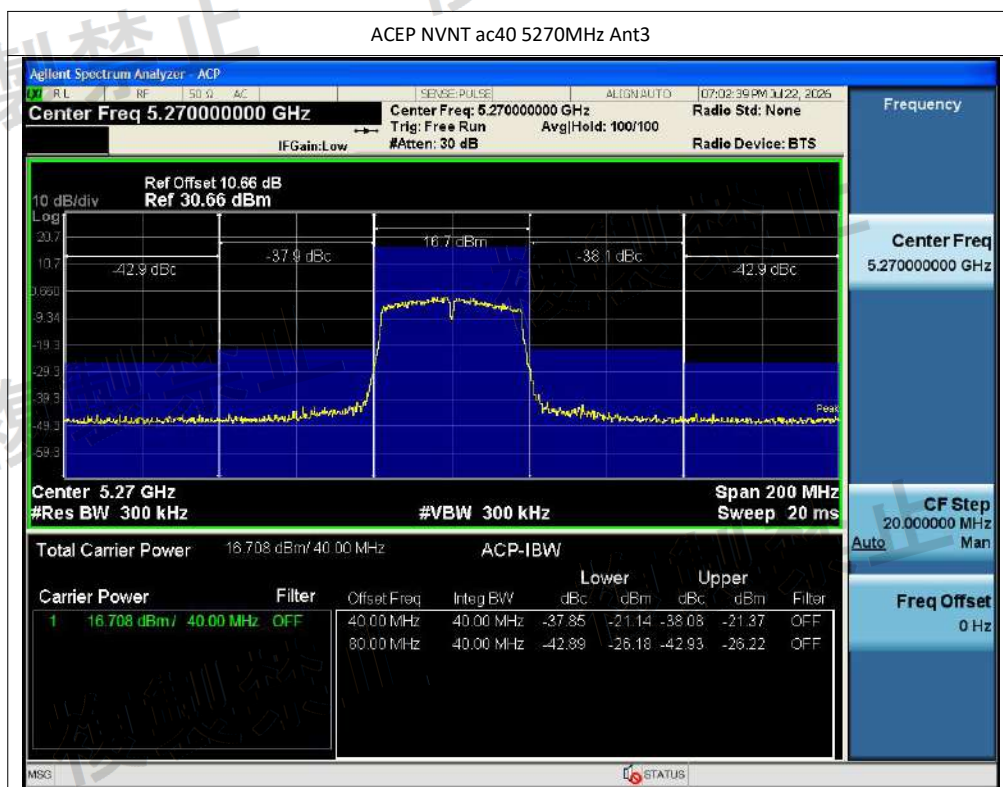


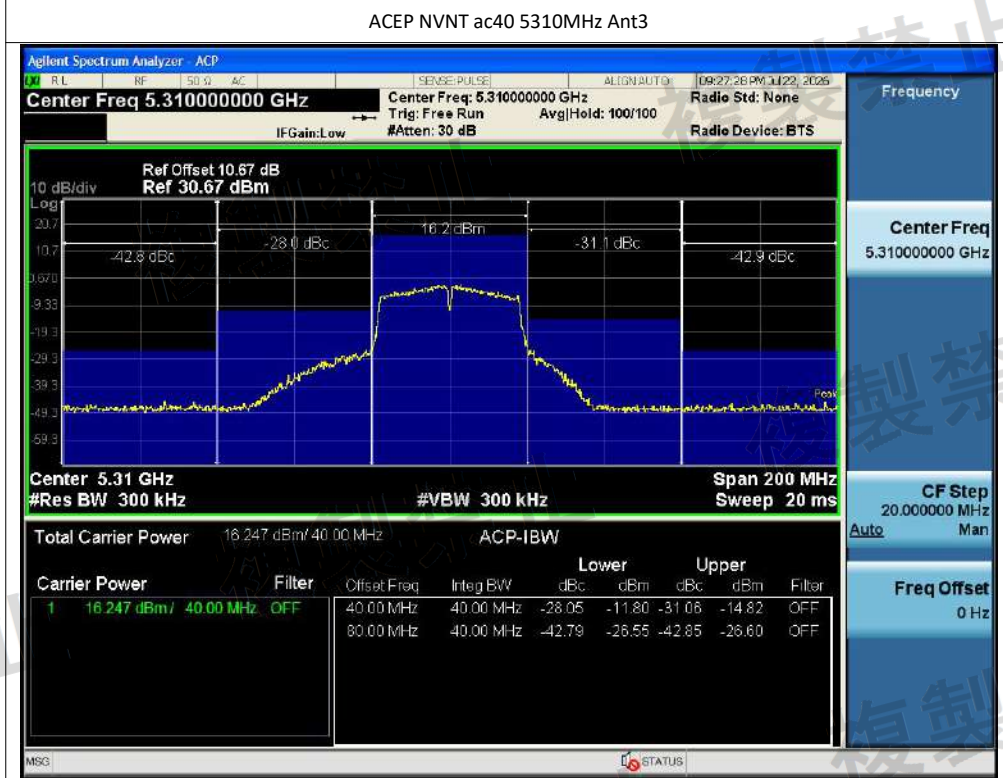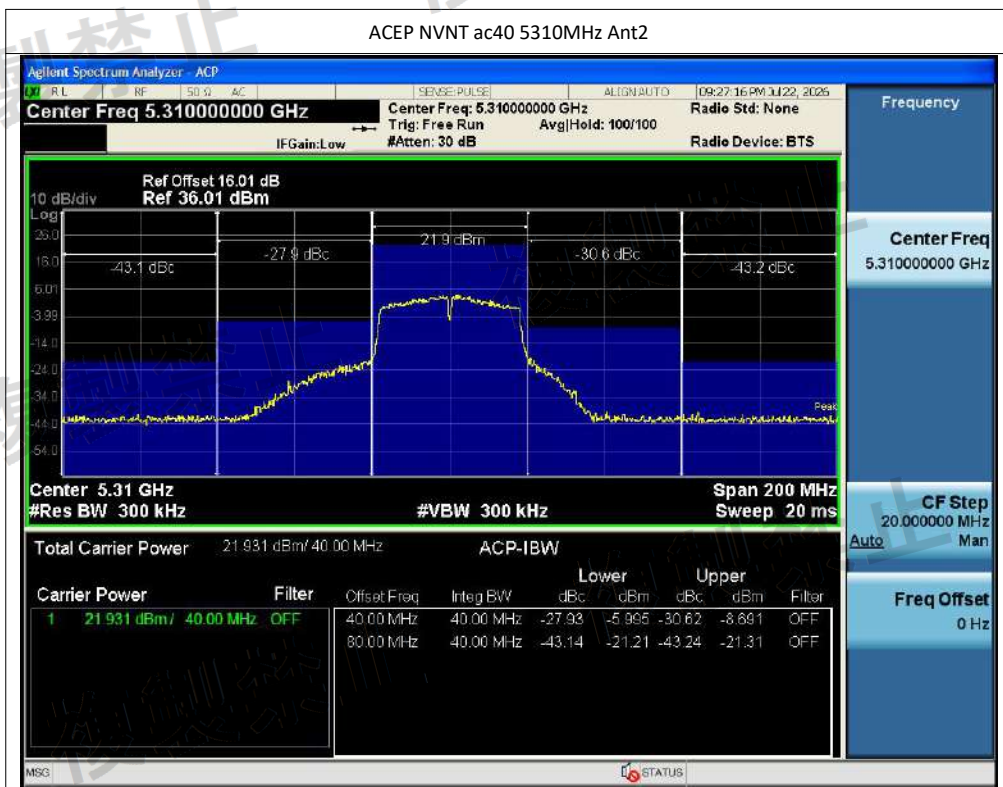


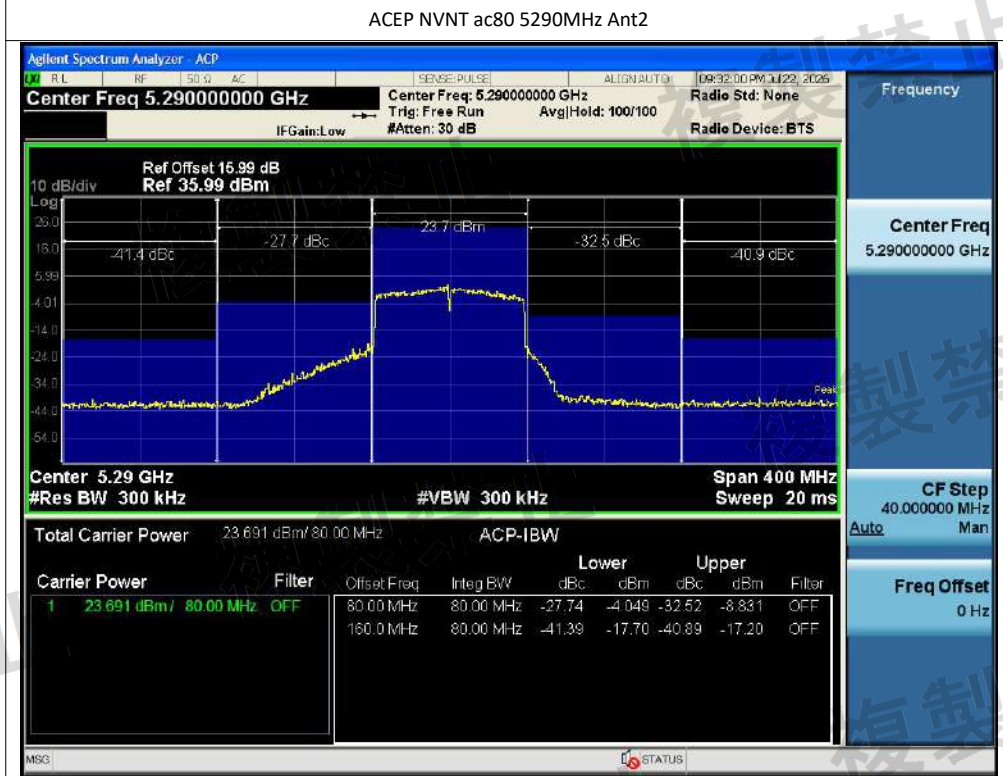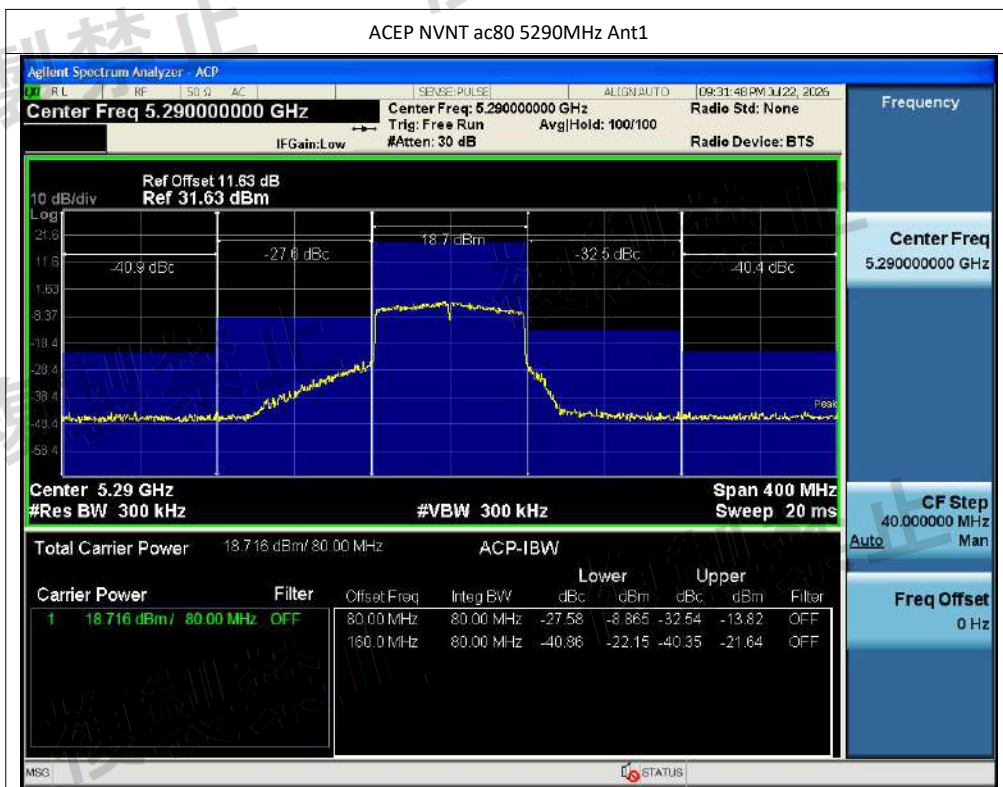


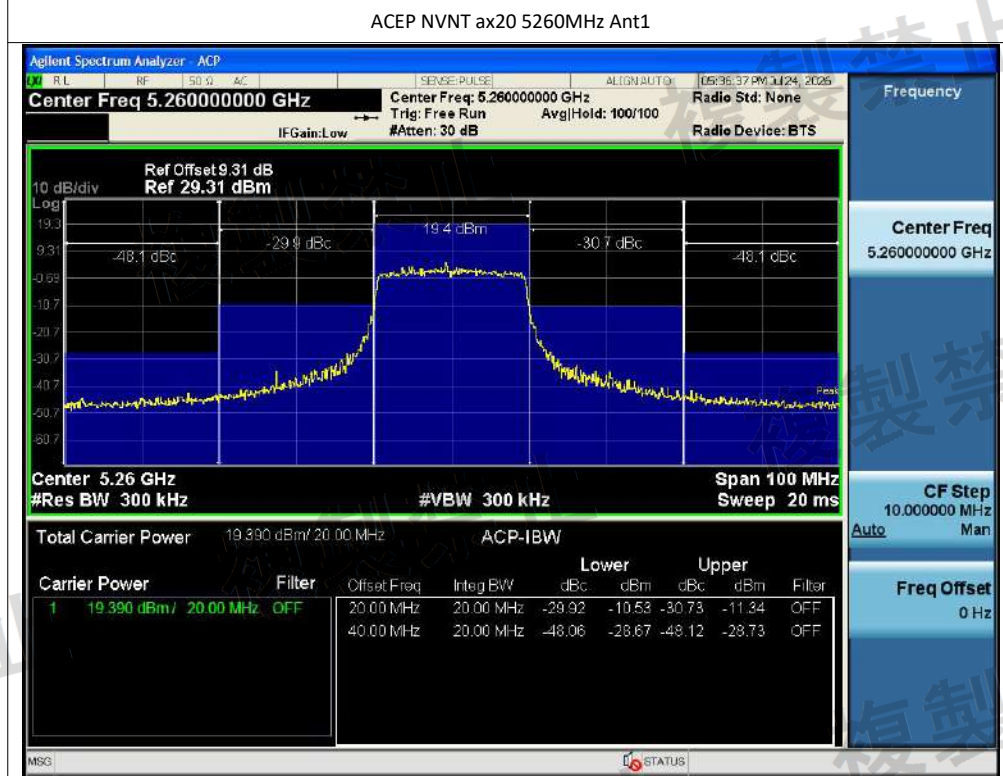


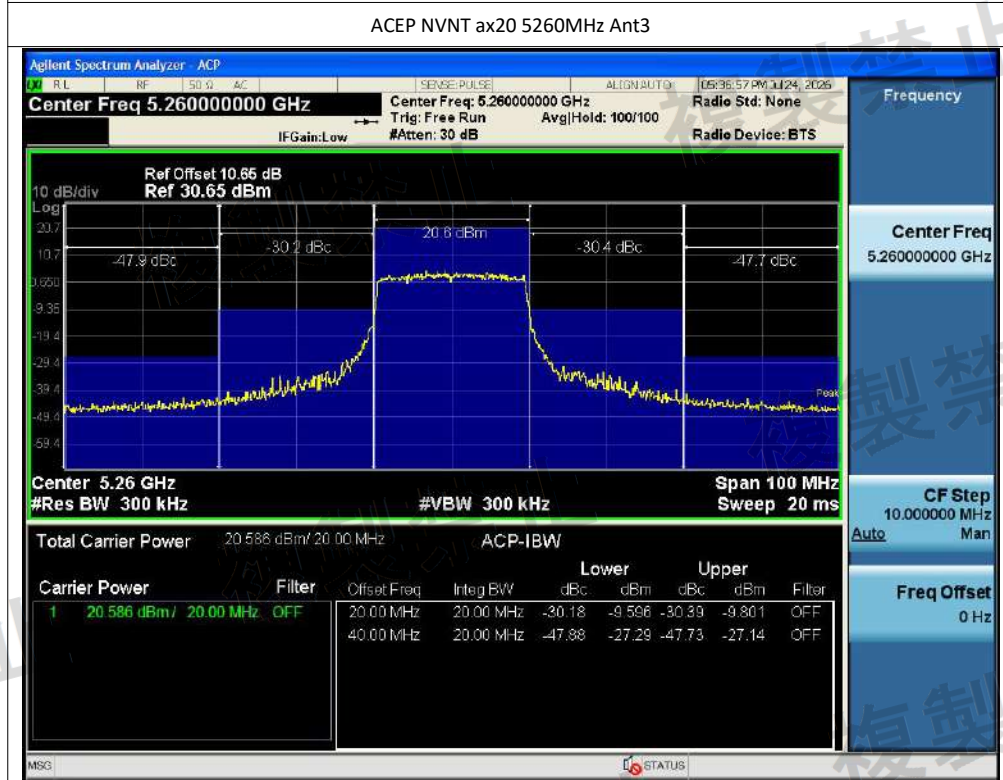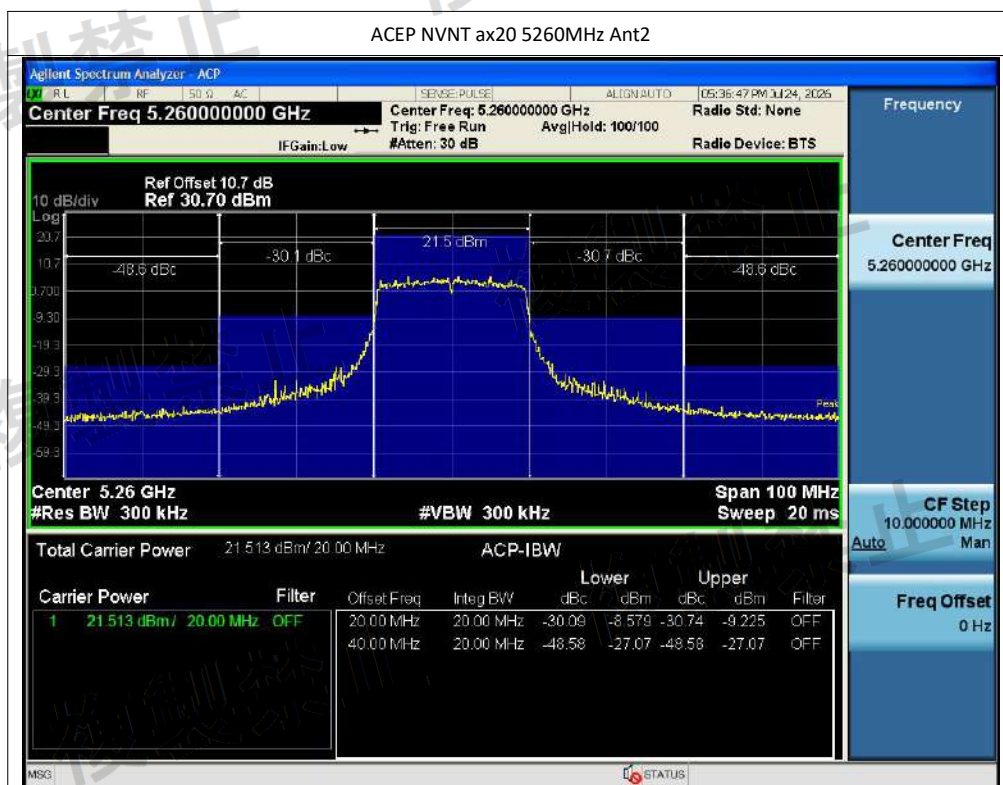


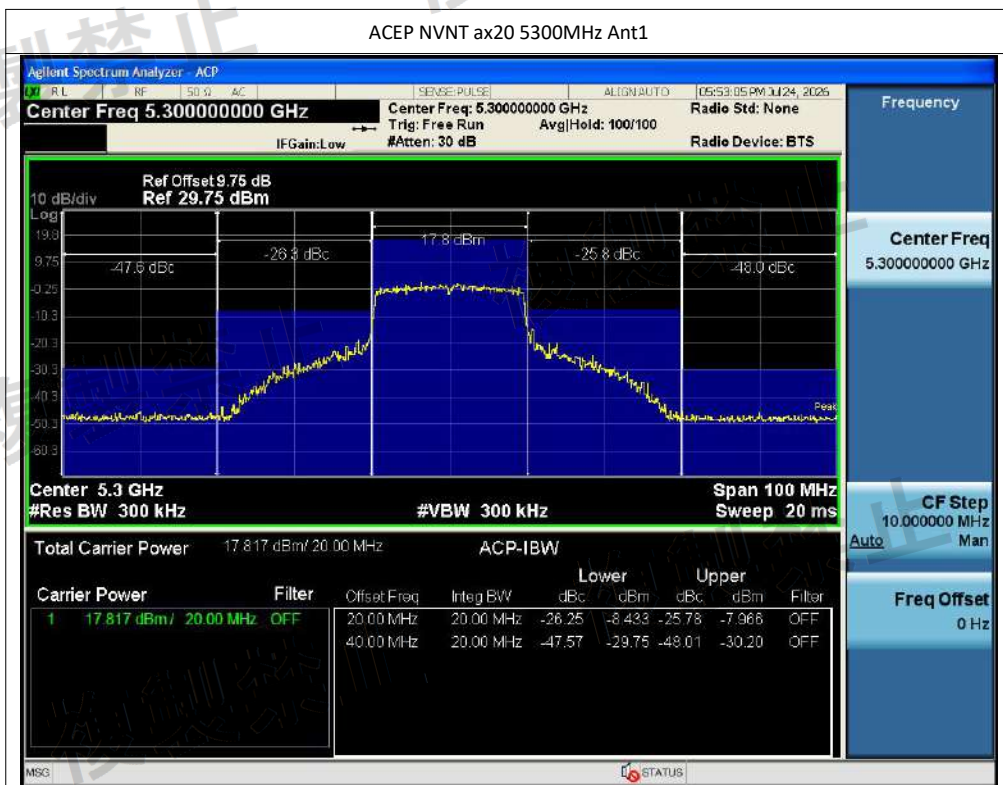



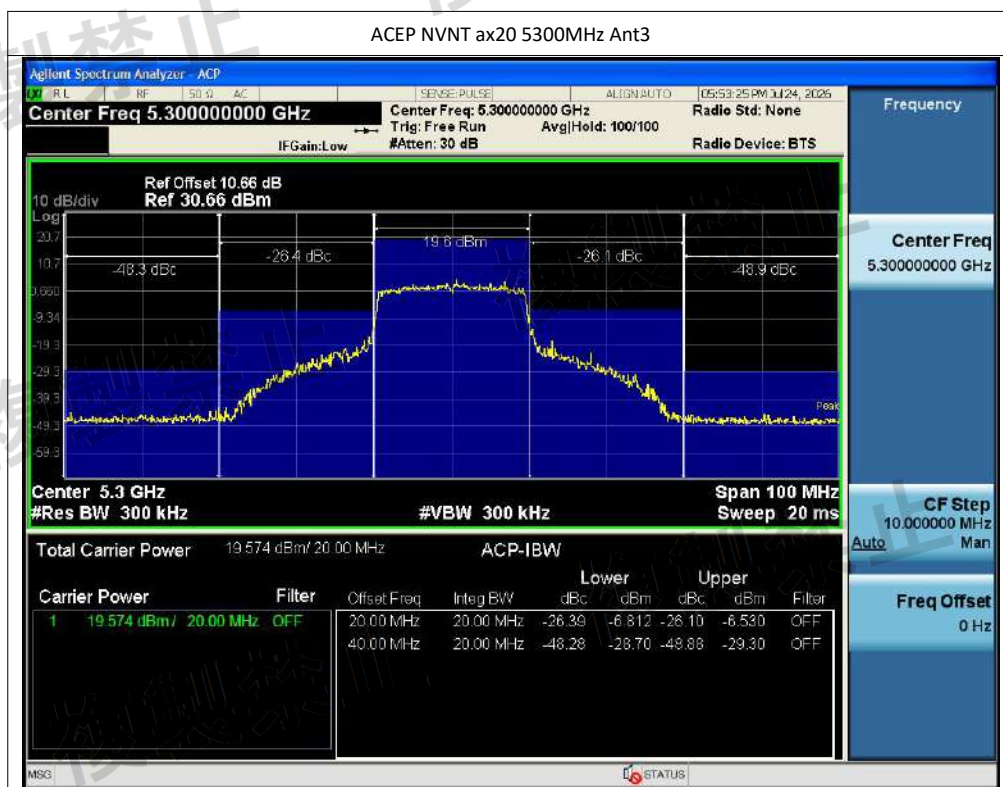



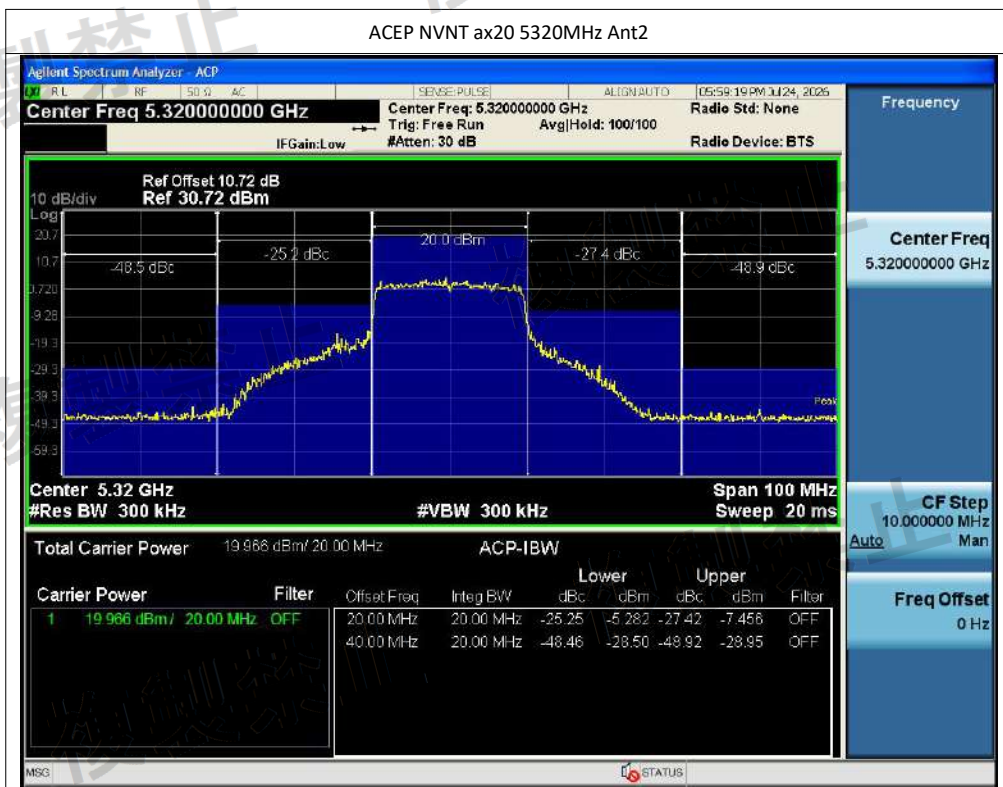



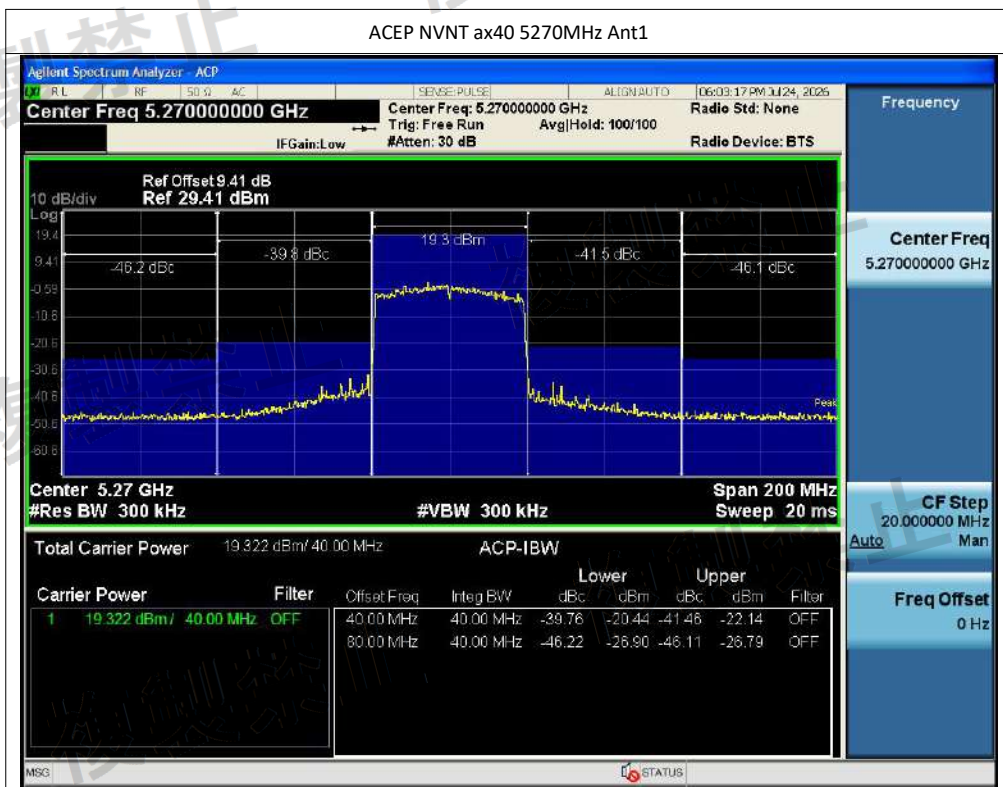



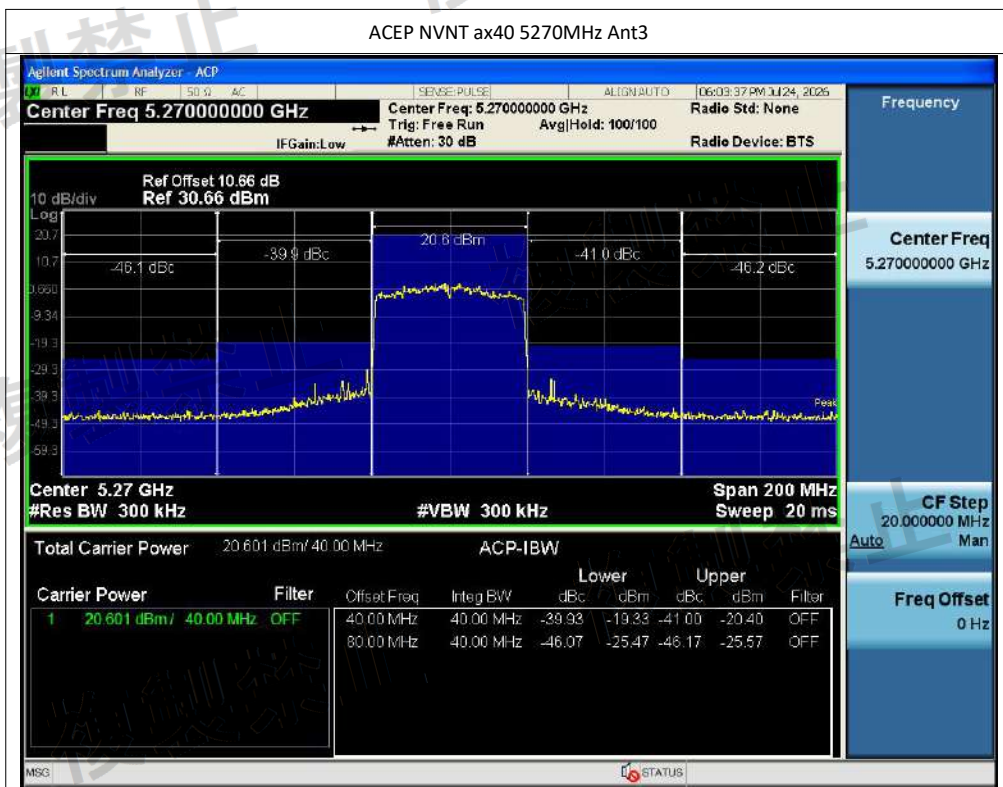


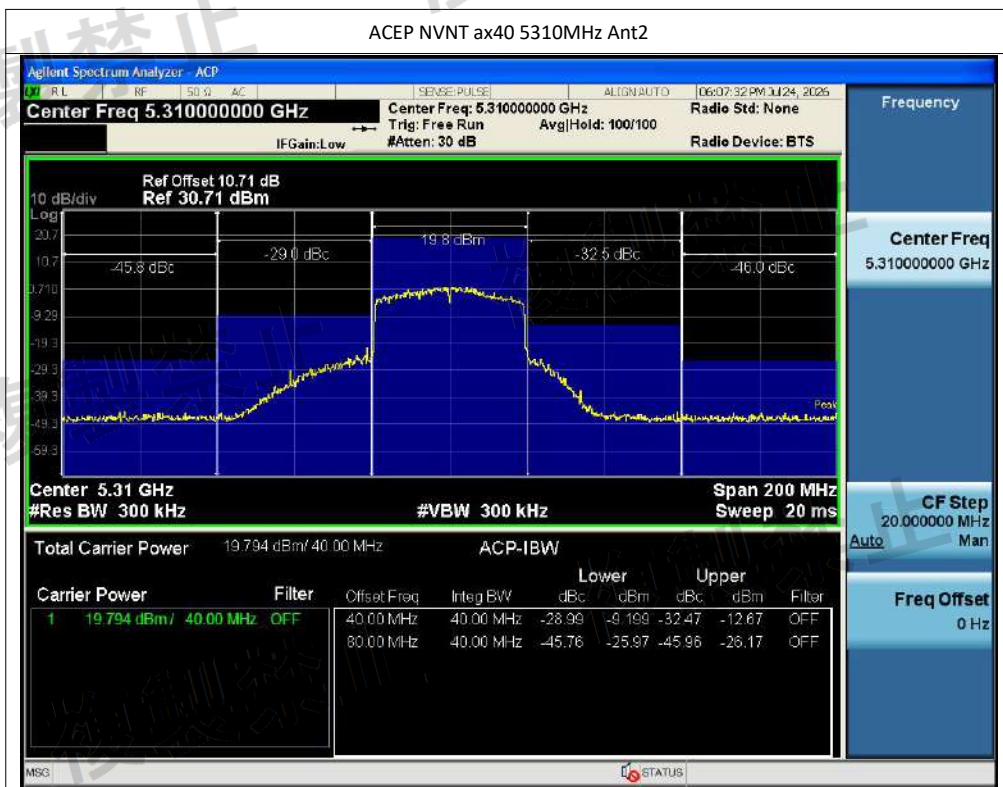


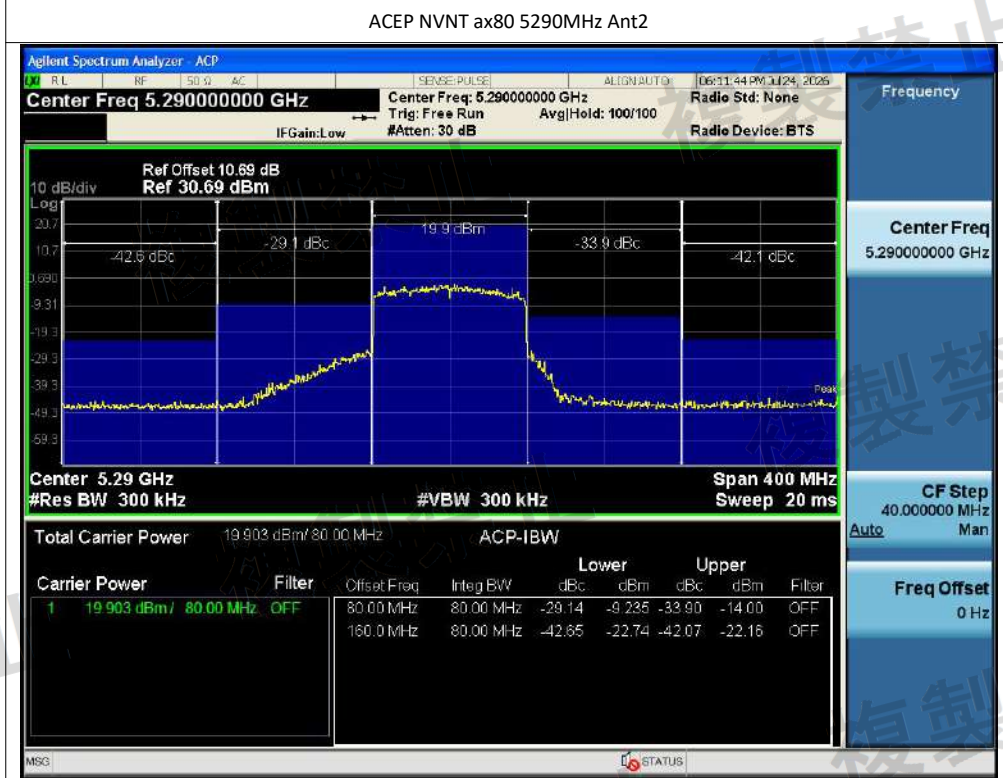
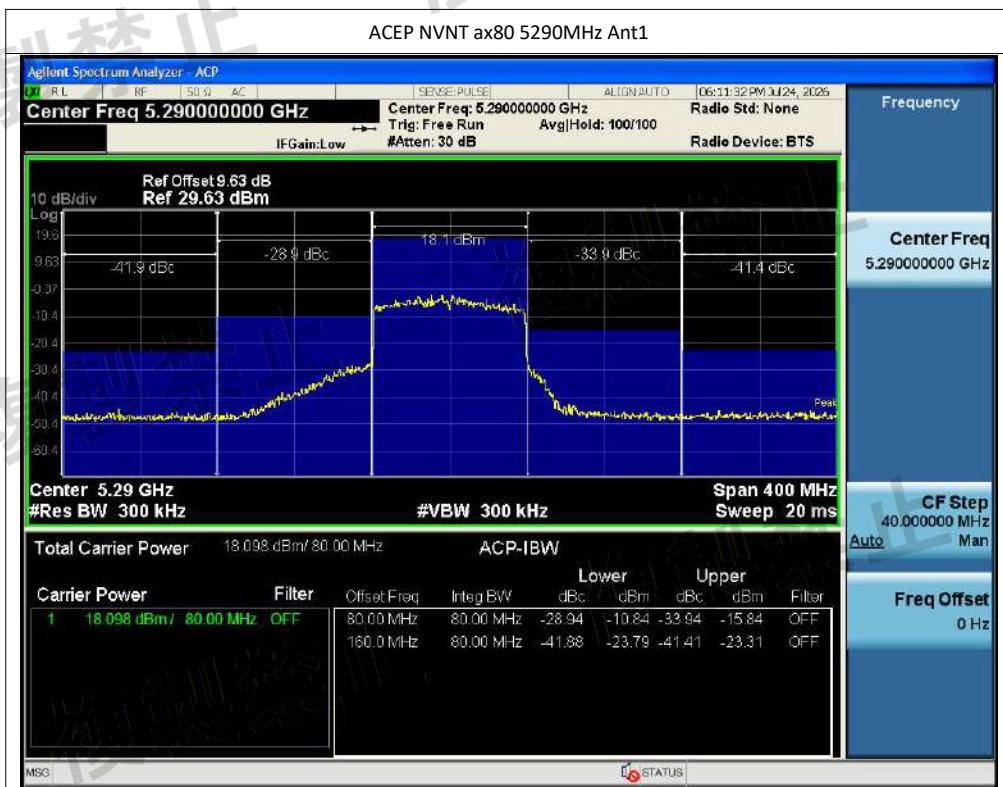


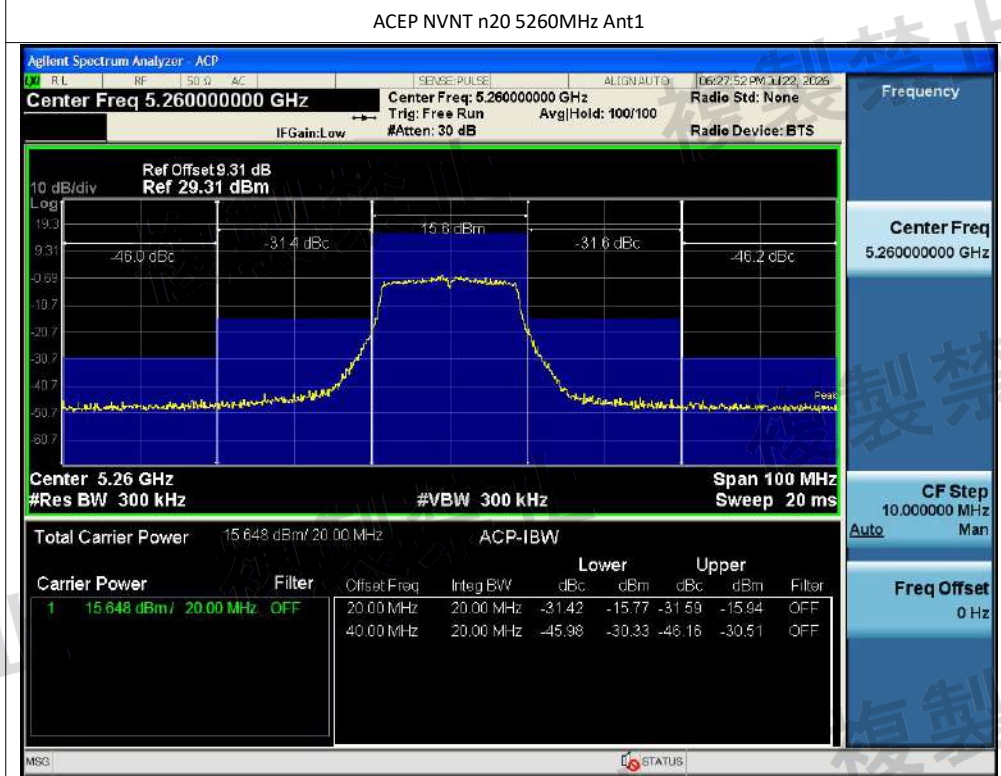
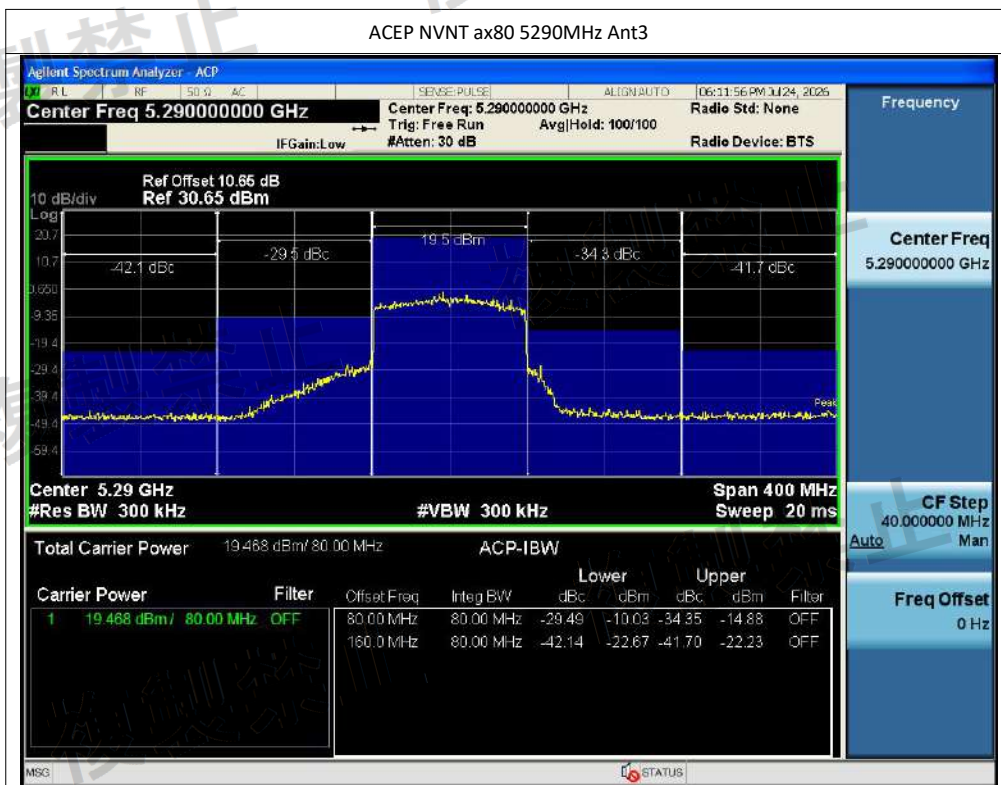


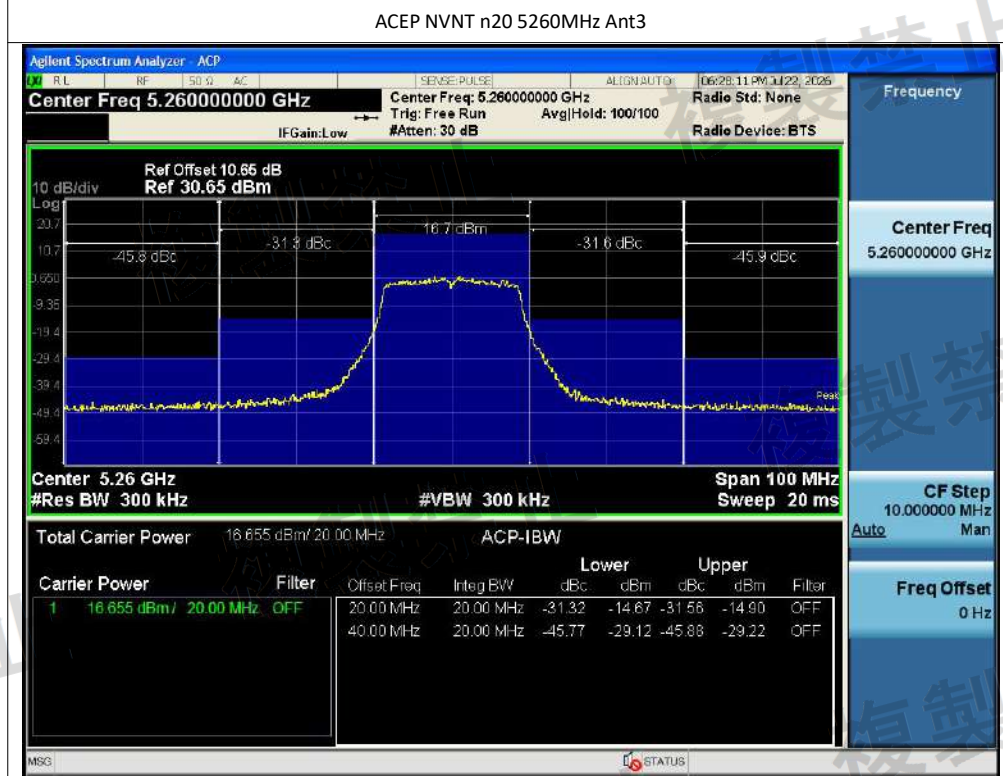
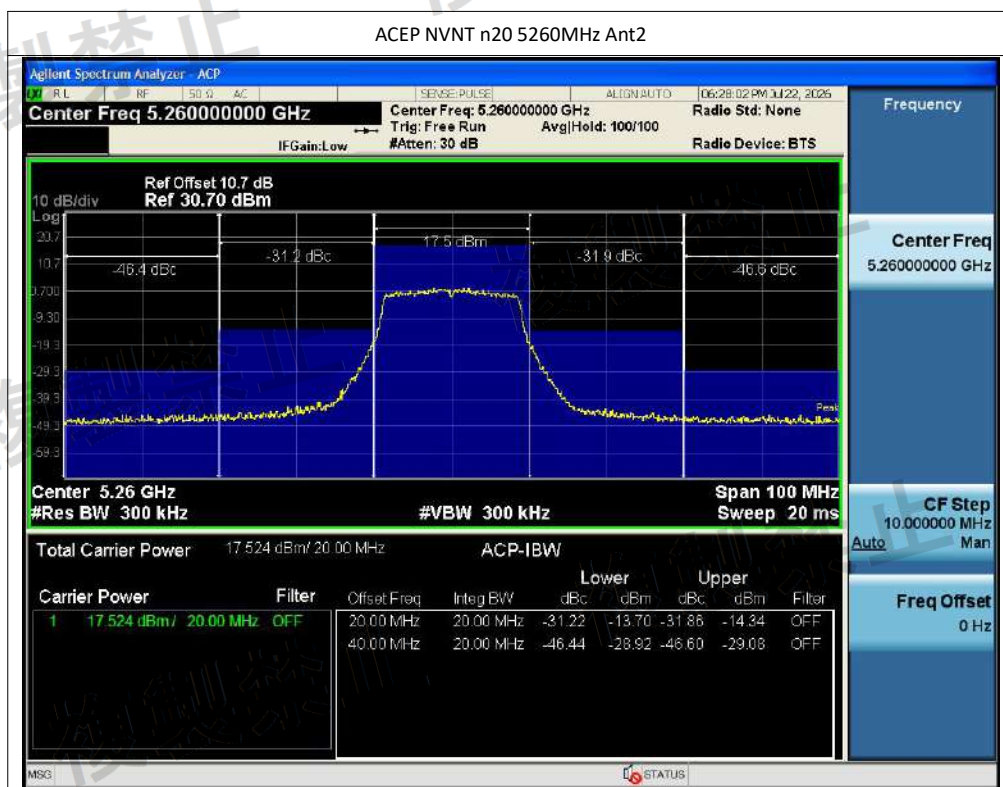


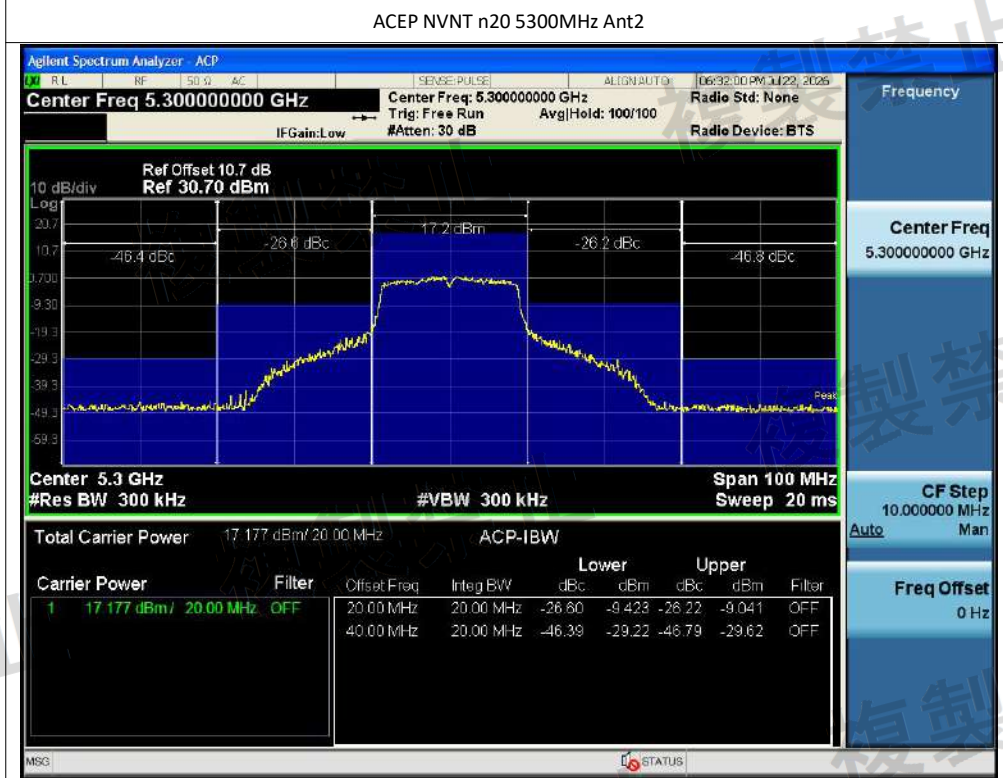
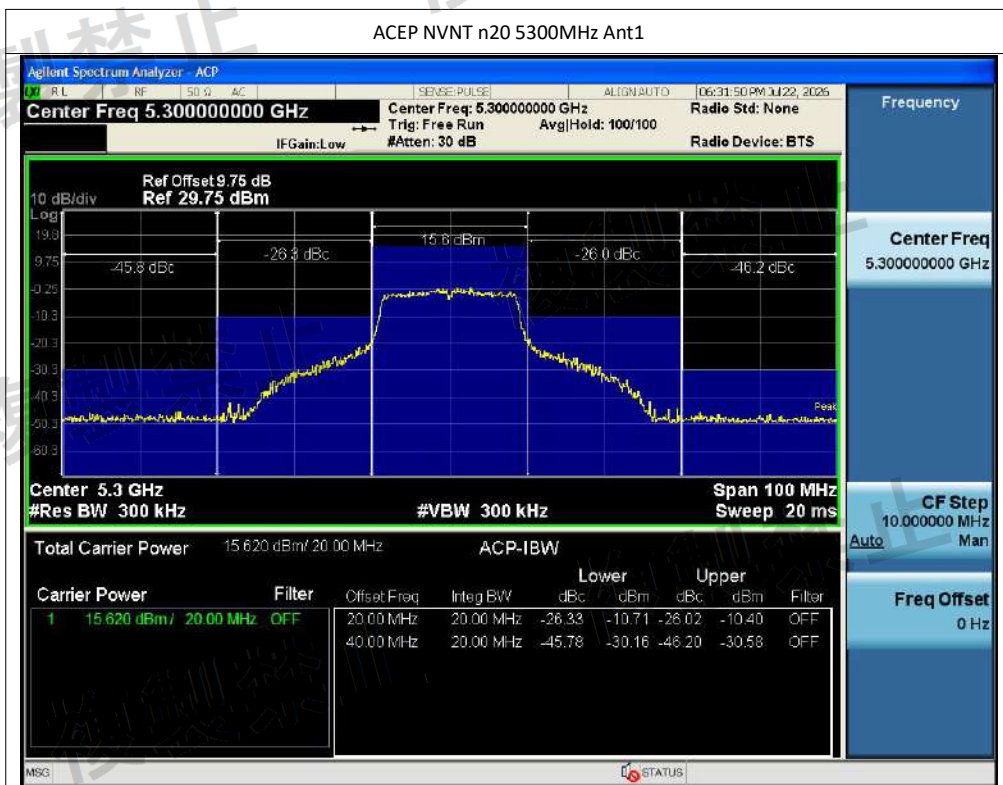


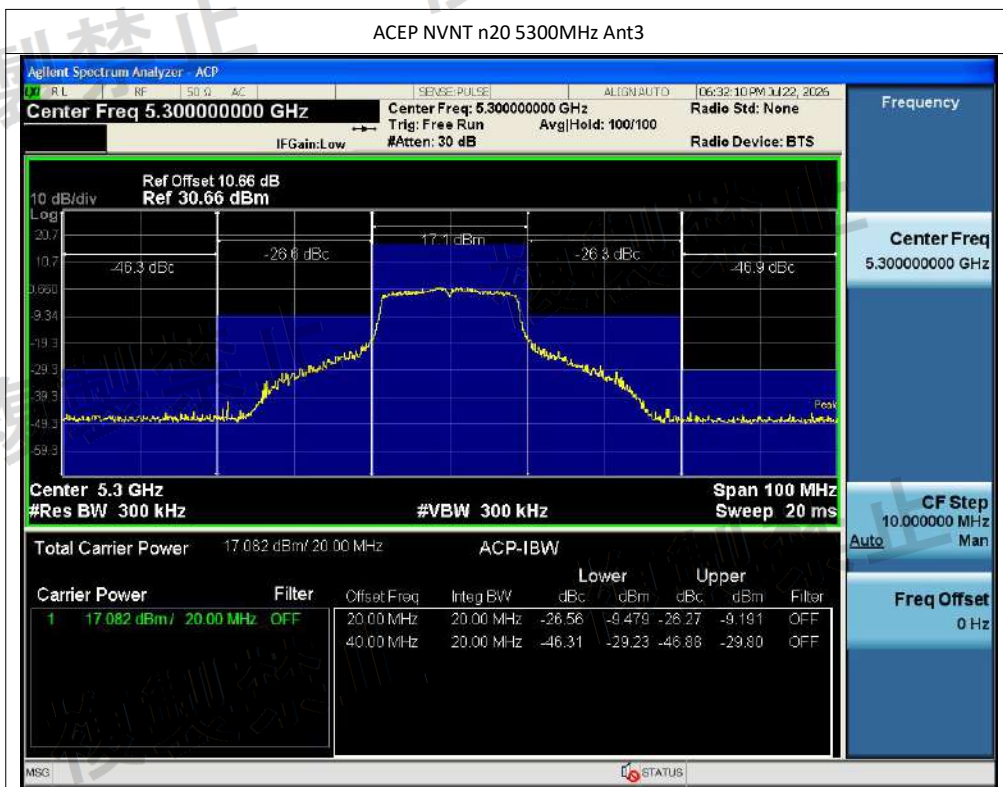

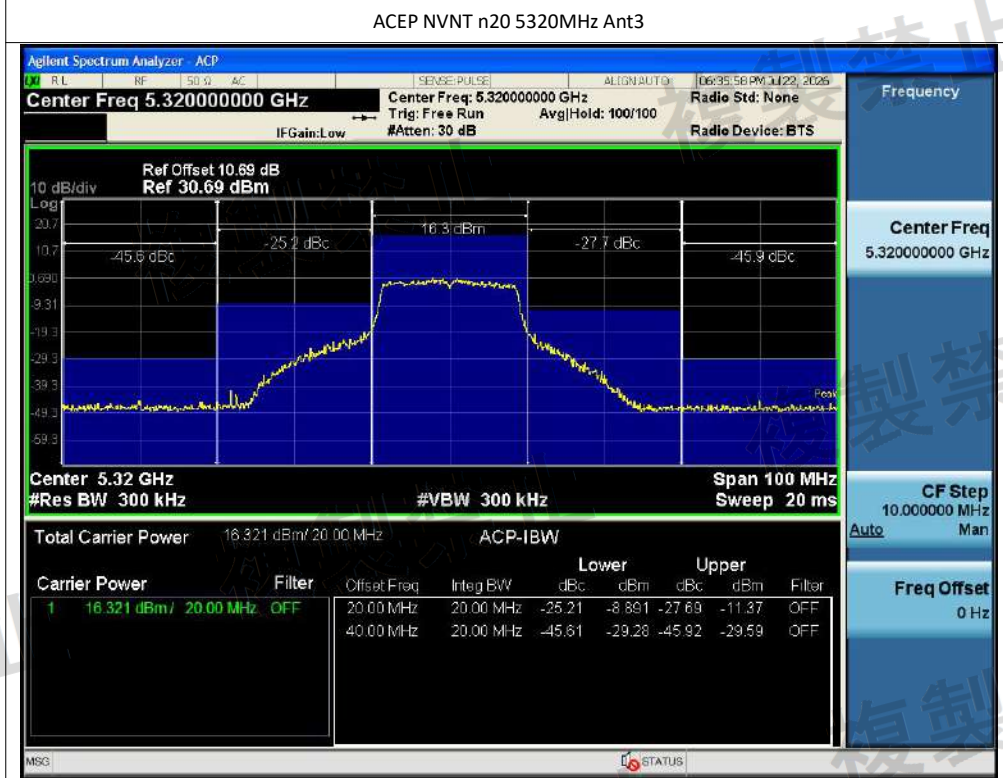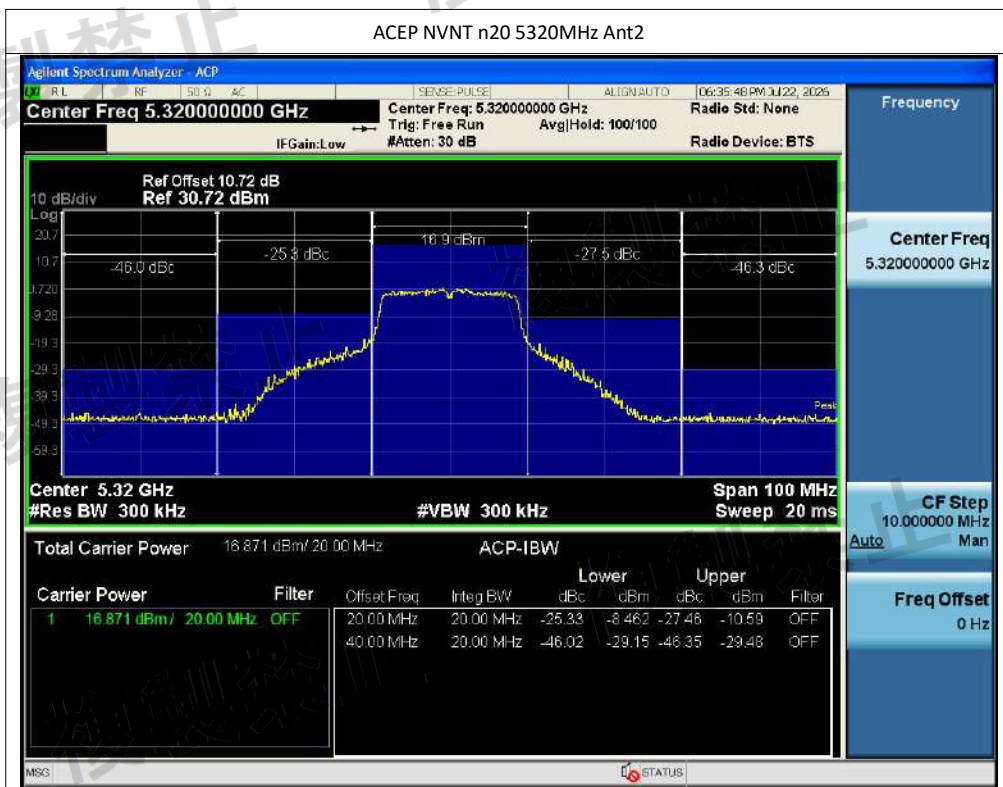

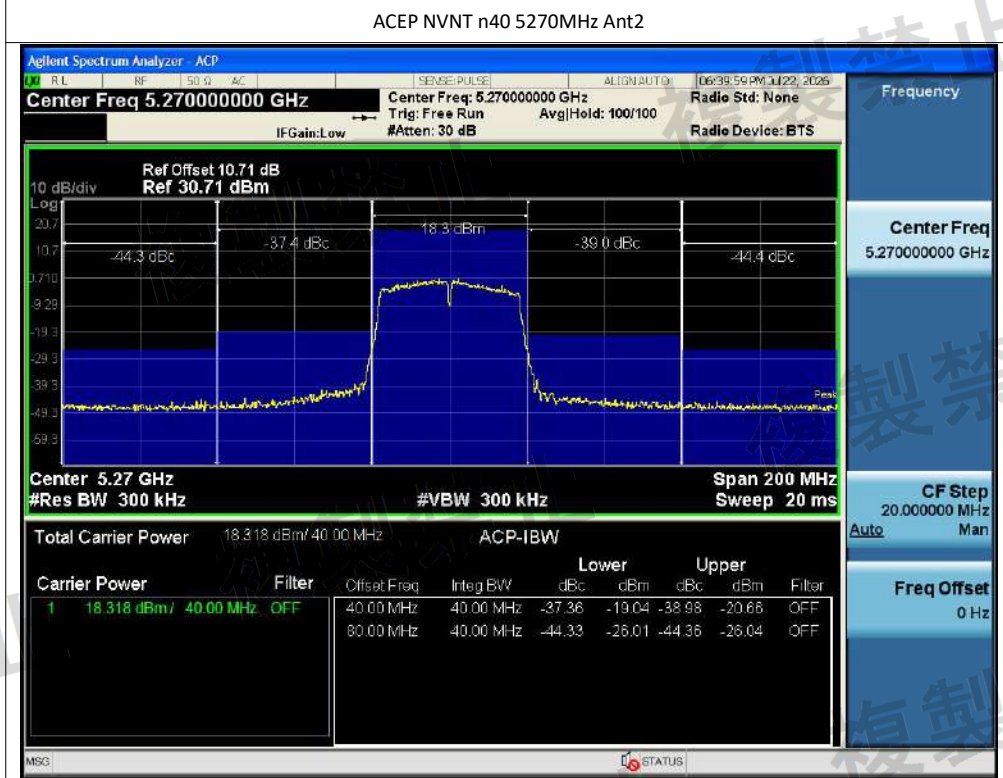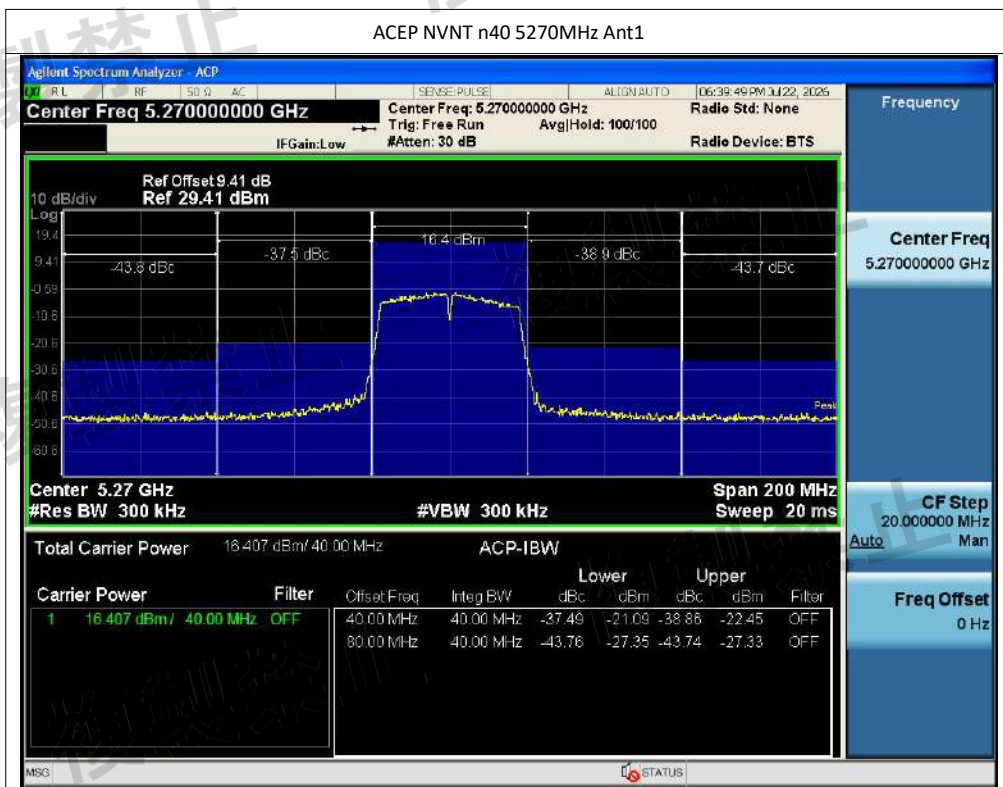

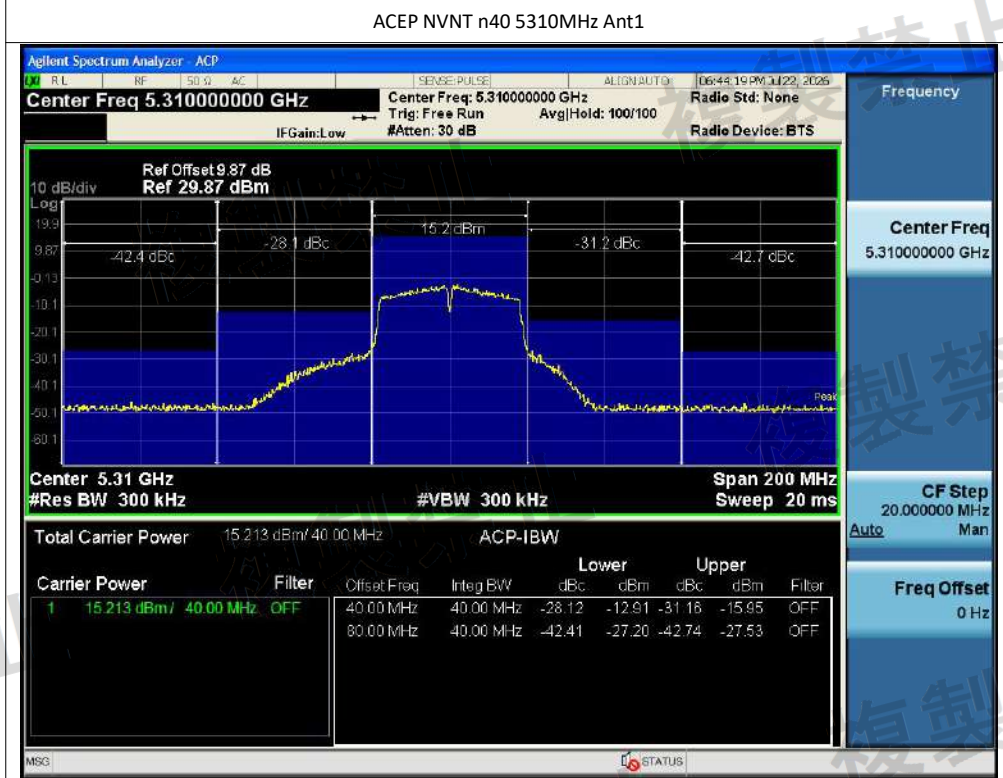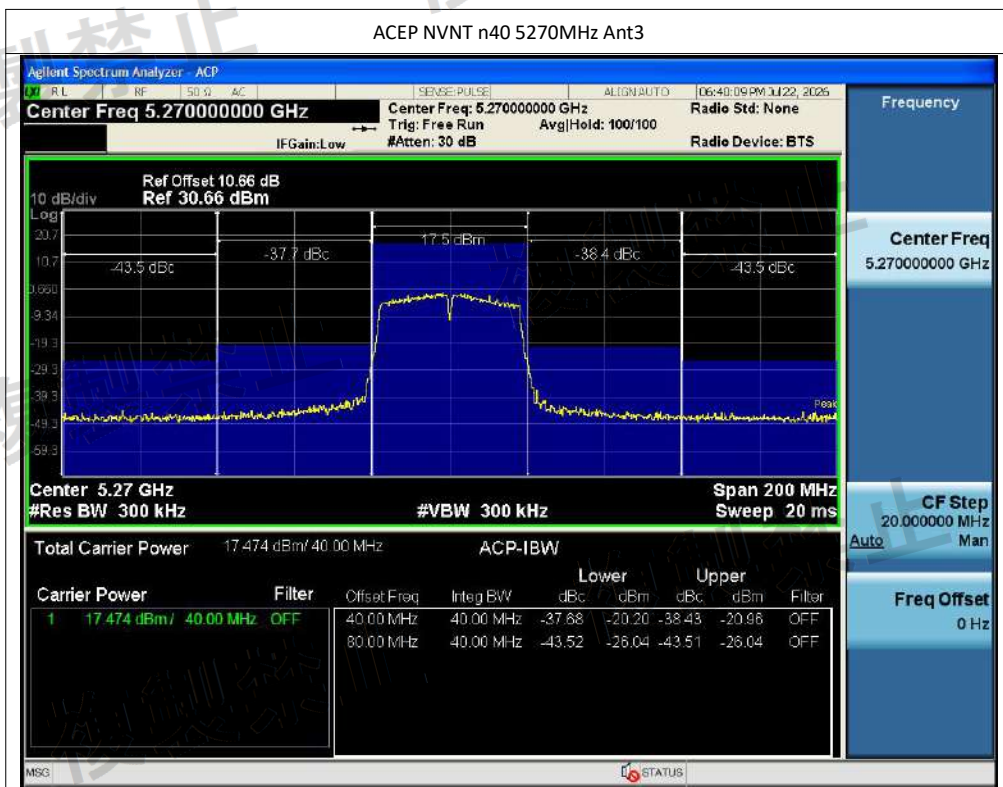

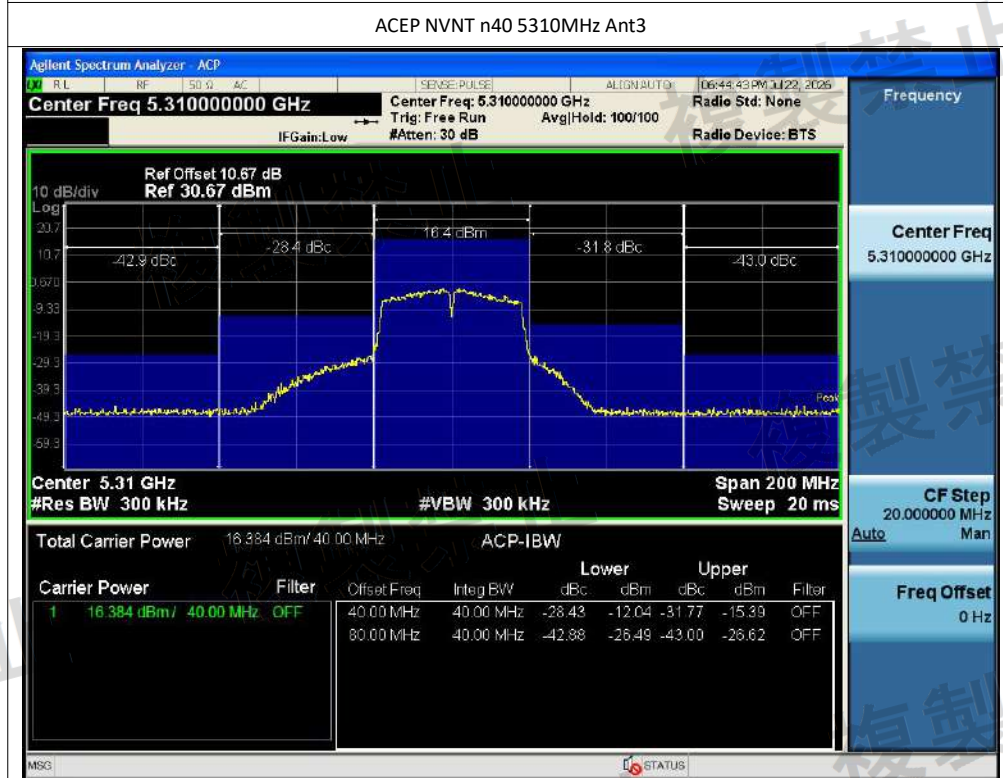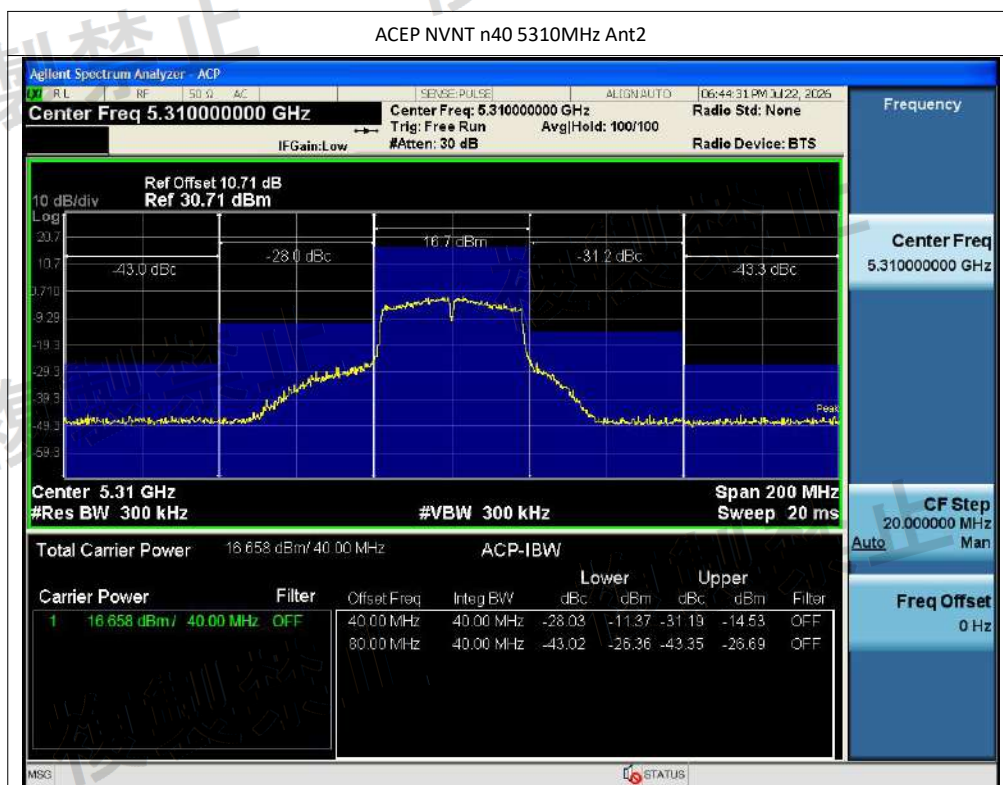


Frequency Error

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ax20	5260	Sum	5259.995	-5000	-0.95	20	Pass
NVNT	ax20	5300	Sum	5299.995	-5000	-0.94	20	Pass
NVNT	ax20	5320	Sum	5319.994	-6000	-1.13	20	Pass
NVNT	ax40	5270	Sum	5269.997	-3000	-0.57	20	Pass
NVNT	ax40	5310	Sum	5309.996	-4000	-0.75	20	Pass
NVNT	ax80	5290	Sum	5289.999	-1000	-0.19	20	Pass


Test Graphs

Freq. Error NVNT ax20 5260MHz Sum

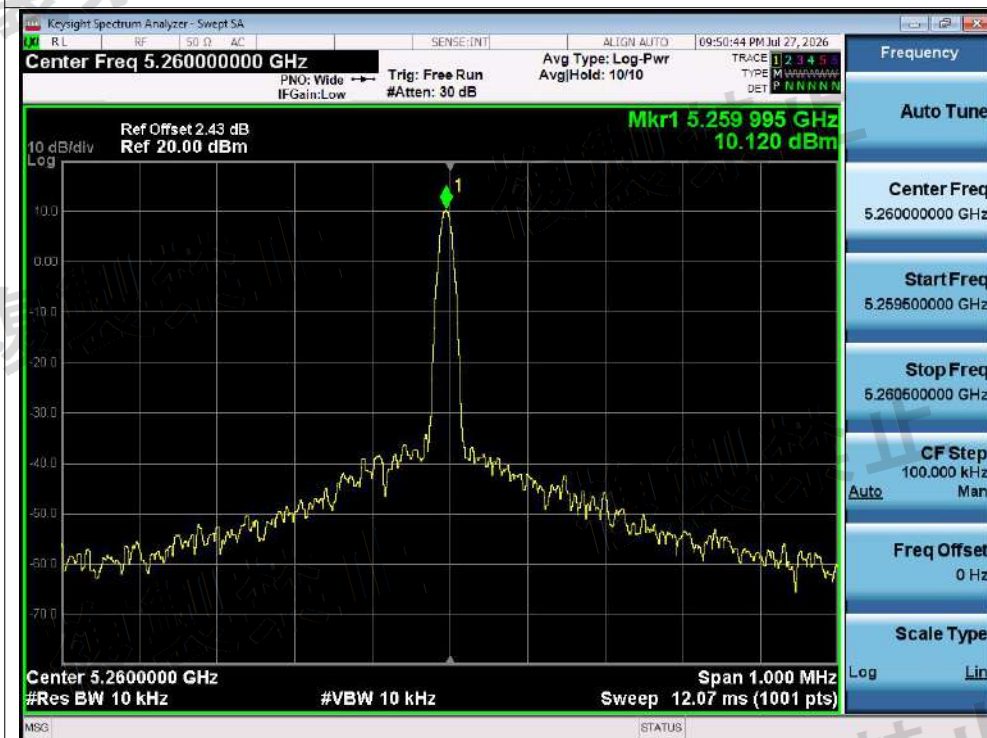

Freq. Error NVNT ax20 5300MHz Sum




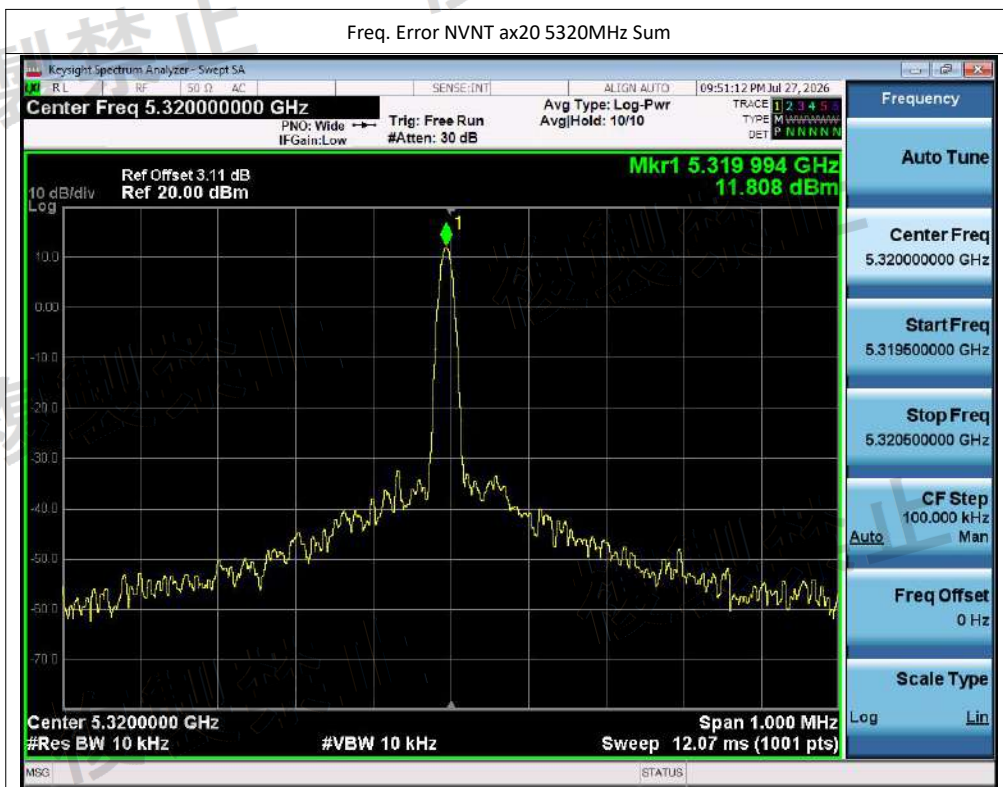




Carrier Sense

Condition	Mode	Frequency (MHz)	Antenna	CW Level (dBm)	Verdict
NVNT	ax80	5290	Sum	-45.34	Pass

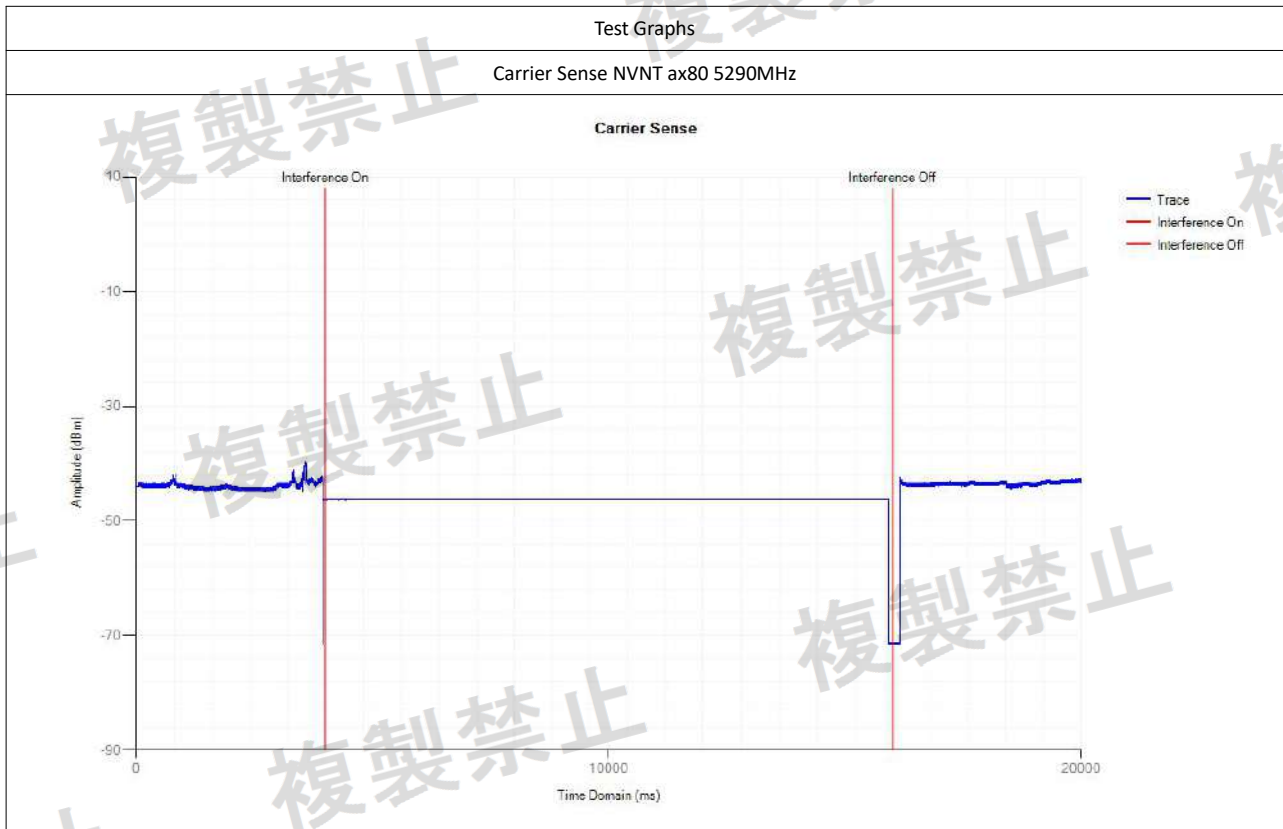


CAC Begin

Mode	Frequency (MHz)	Type	Number	Result	Verdict
ax80	5290	DFS_W53_FP1	1	See test Graph	Pass

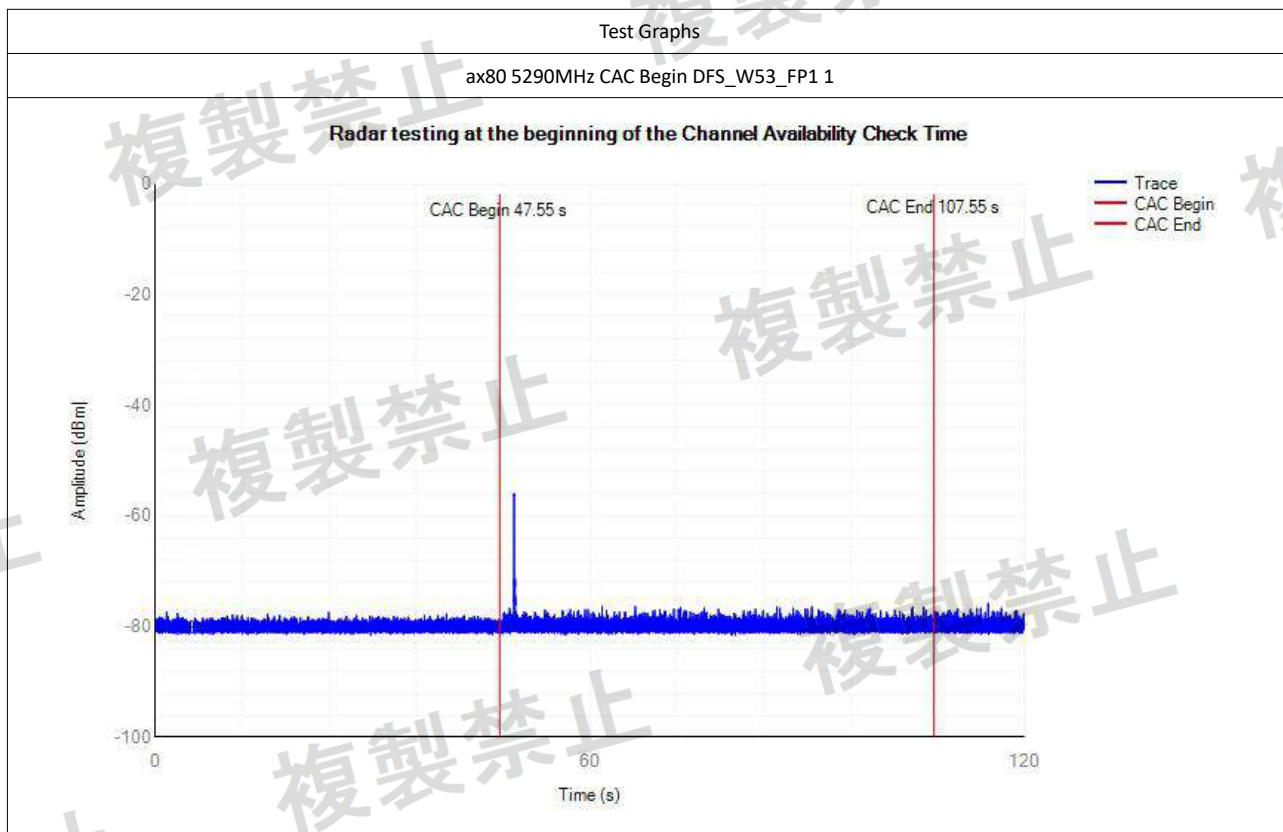


CAC End

Mode	Frequency (MHz)	Type	Number	Result	Verdict
ax80	5290	DFS_W53_FP1	1	See test Graph	Pass

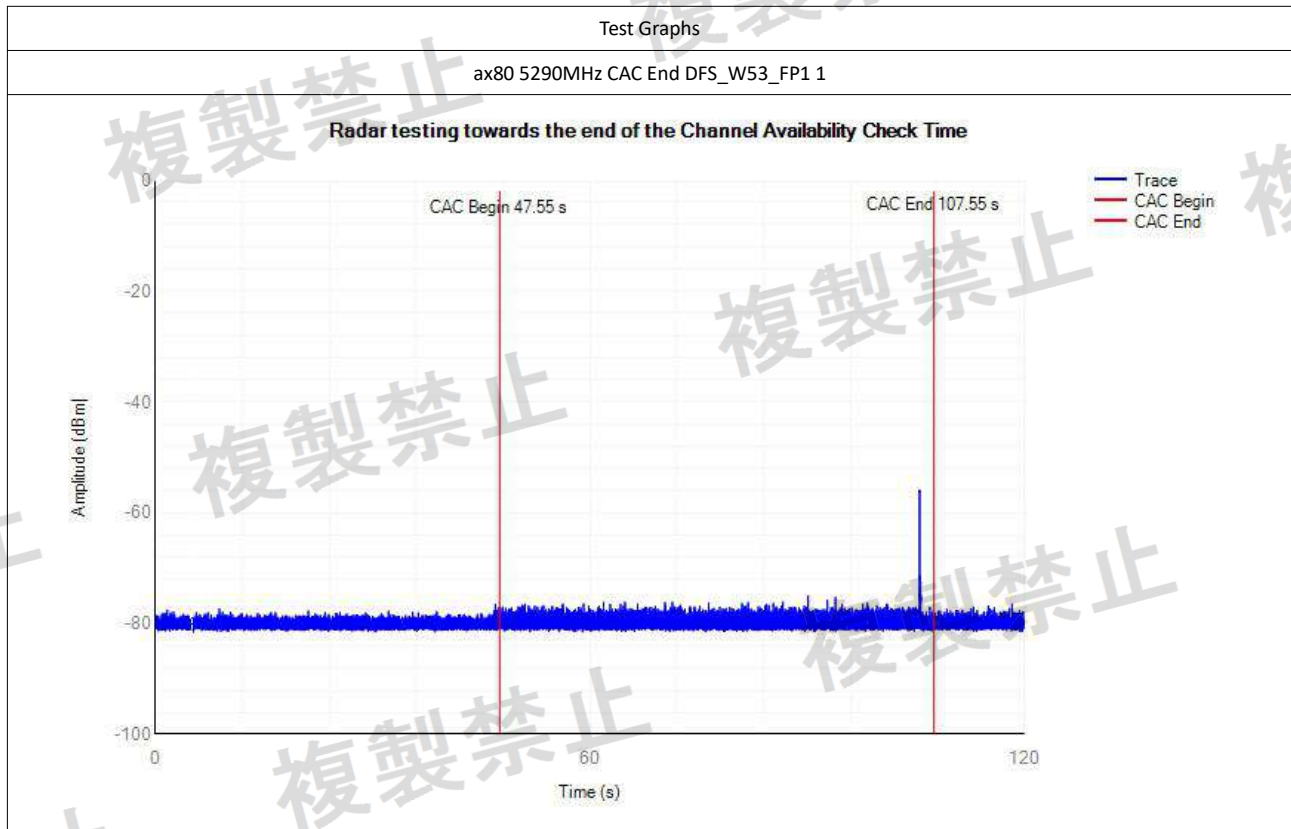


CAC Initial

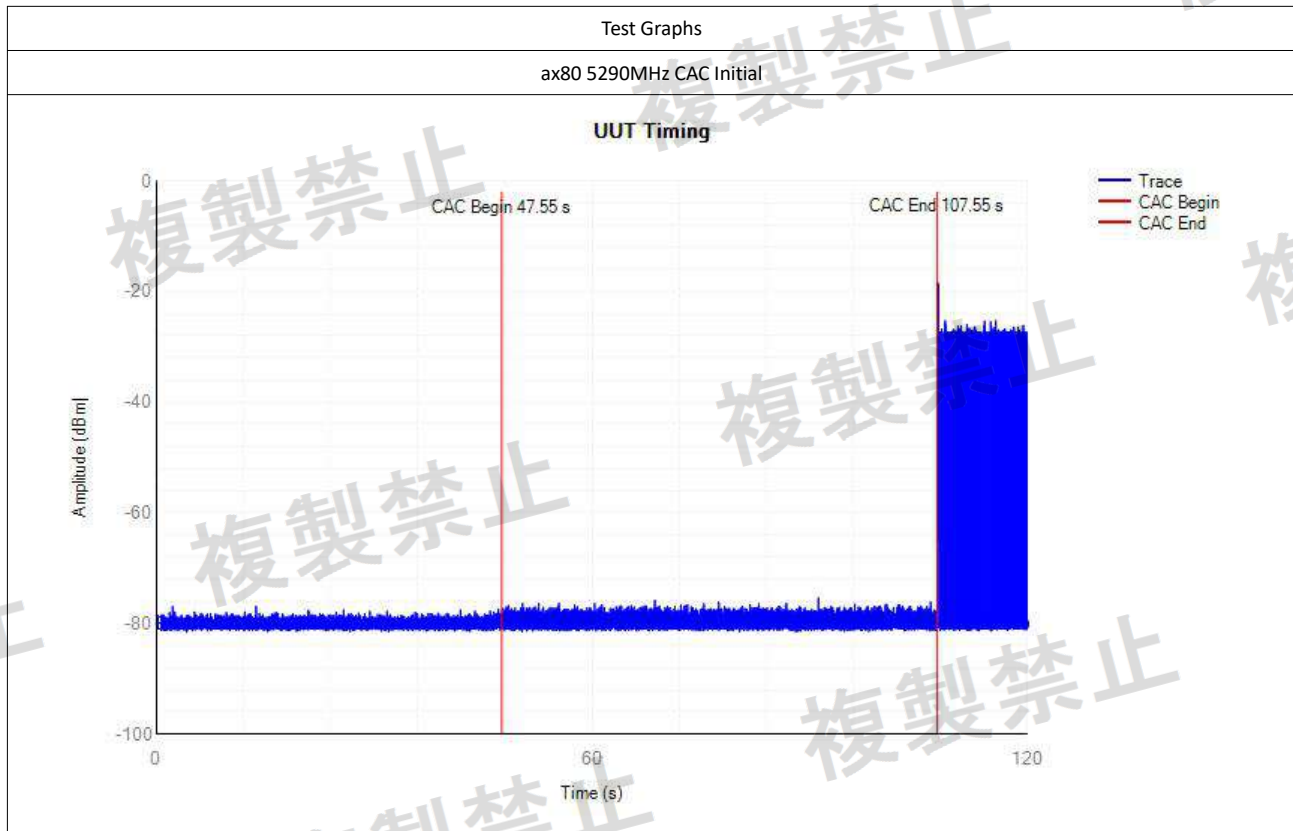



Calibration

Mode	Frequency (MHz)	Type	Result	Verdict
ax80	5290	DFS_W53_FP1	See test Graph	Pass

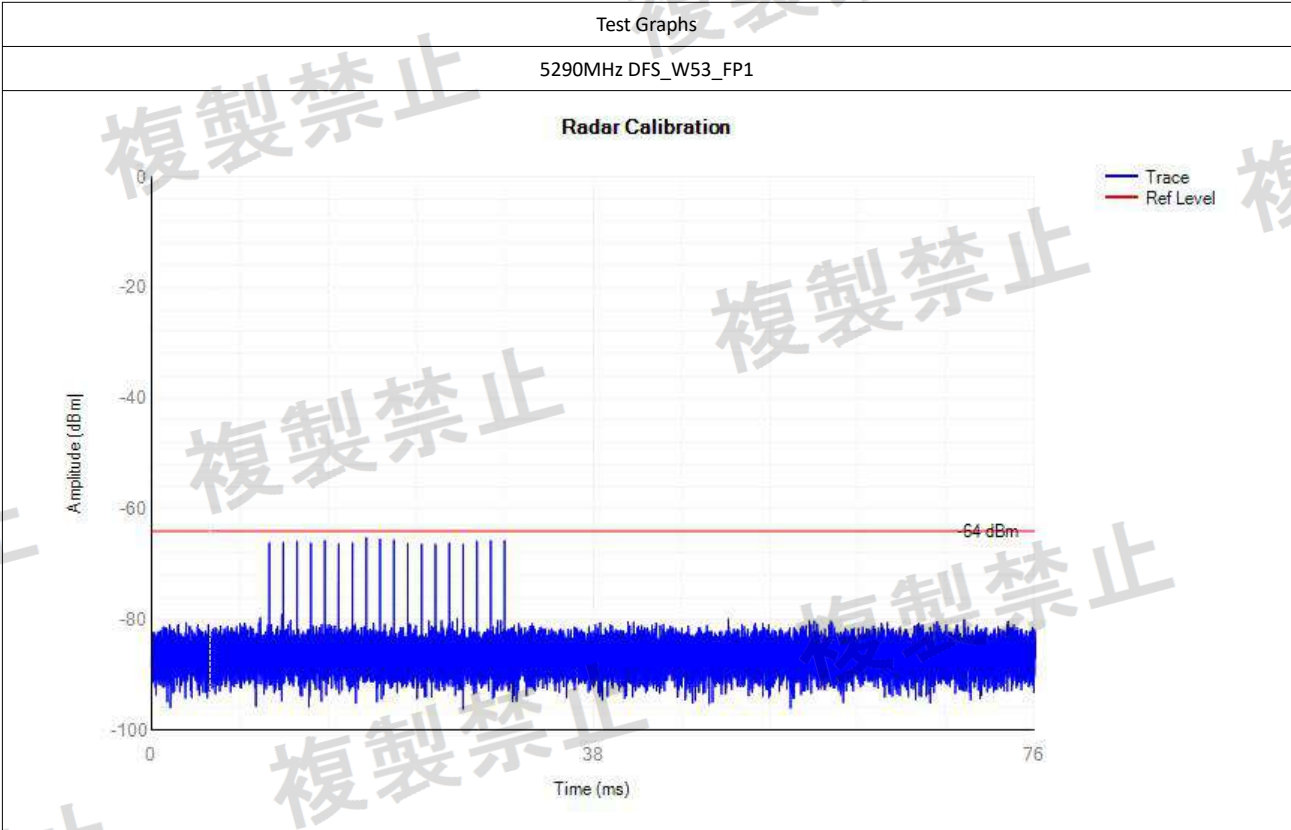




CAC Pd

Mode	Frequency (MHz)	Radar Type	Detection Threshold (dBm)	Total No.	Detected No.	Detection Rate (%)	Limit (%)	Verdict
ax80	5290	W53_VP3	-60	2	2	100	60	Pass
ax80	5290	W53_VP4	-60	8	8	100	60	Pass
ax80	5290	W53_Chirp5	-60	10	10	100	60	Pass
ax80	5290	W53_Chirp6	-60	14	14	100	60	Pass
ax80	5290	W53_Chirp7	-60	13	13	100	60	Pass
ax80	5290	W53_Chirp8	-60	17	17	100	60	Pass
ax80	5290	W53_Chirp9	-60	18	18	100	60	Pass
ax80	5290	W53_Chirp10	-60	20	20	100	60	Pass

Non-Occupancy

Mode	Frequency (MHz)	Result	Verdict
ax80	5290	See test Graph	Pass

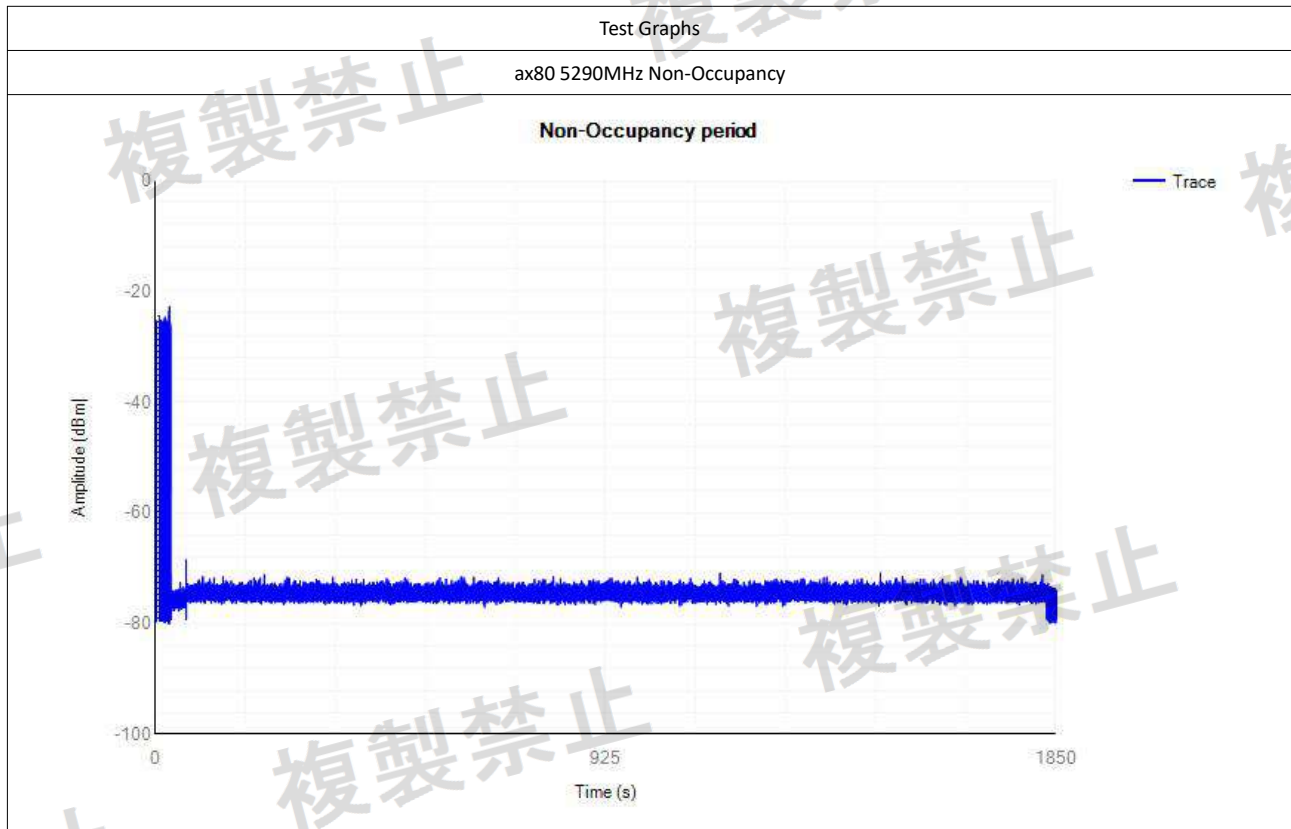

Shutdown Time

Mode	Frequency (MHz)	Channel Move Time (s)	Limit Channel Move Time (s)	Close Transmission Time (s)	Limit Close Transmission Time (s)	Verdict
ax80	5290	0.1158	10	0.0112	0.26	Pass

