



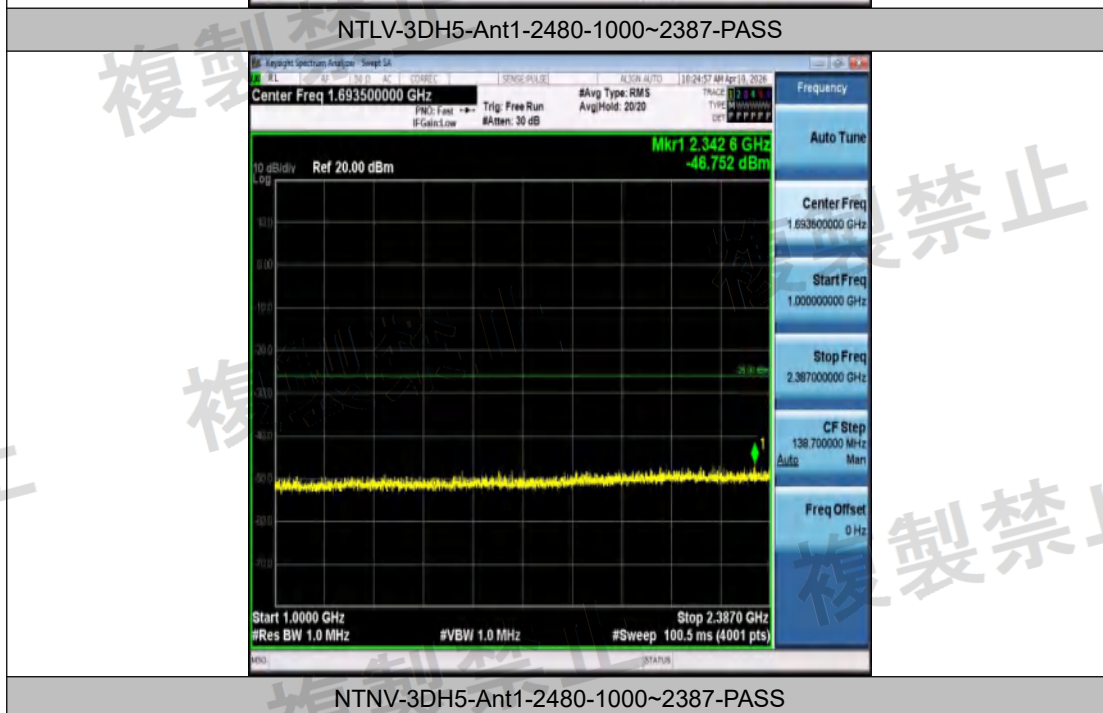
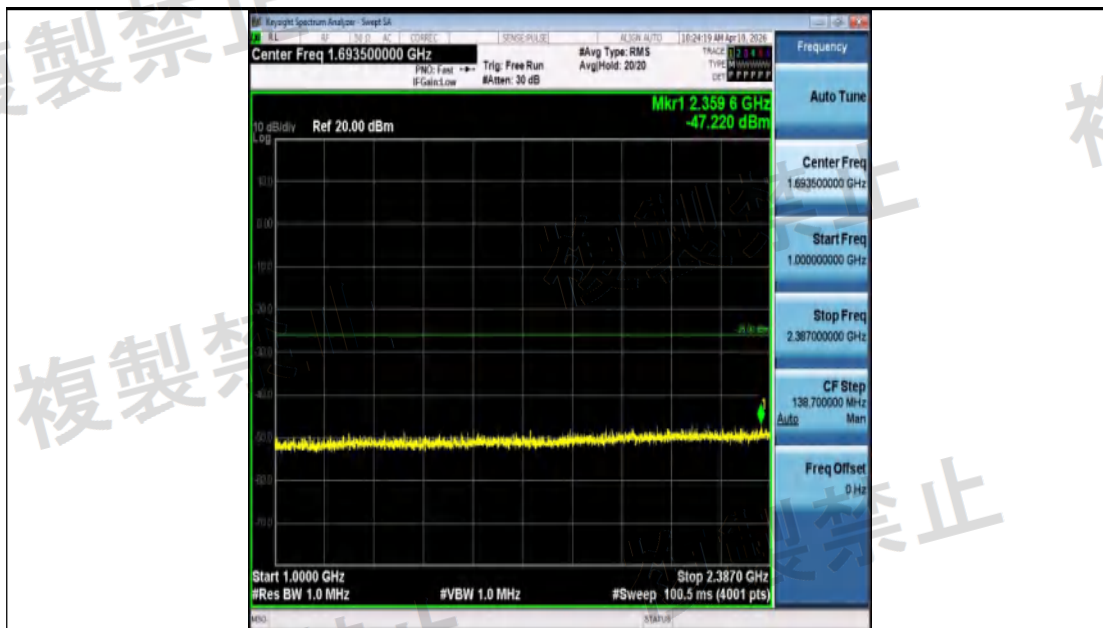


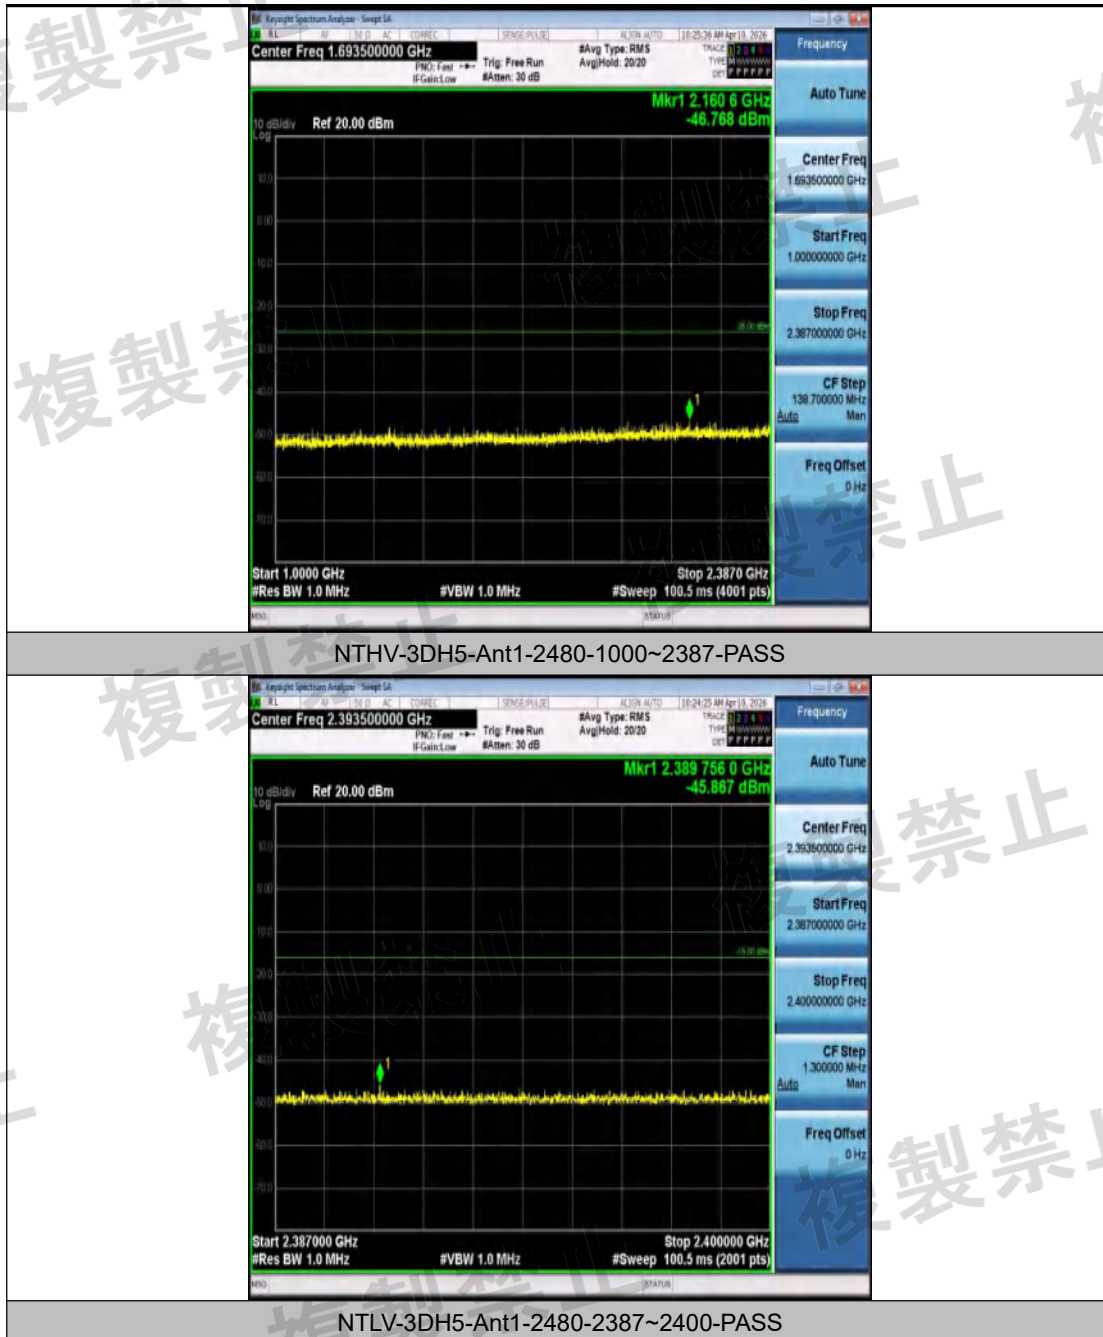


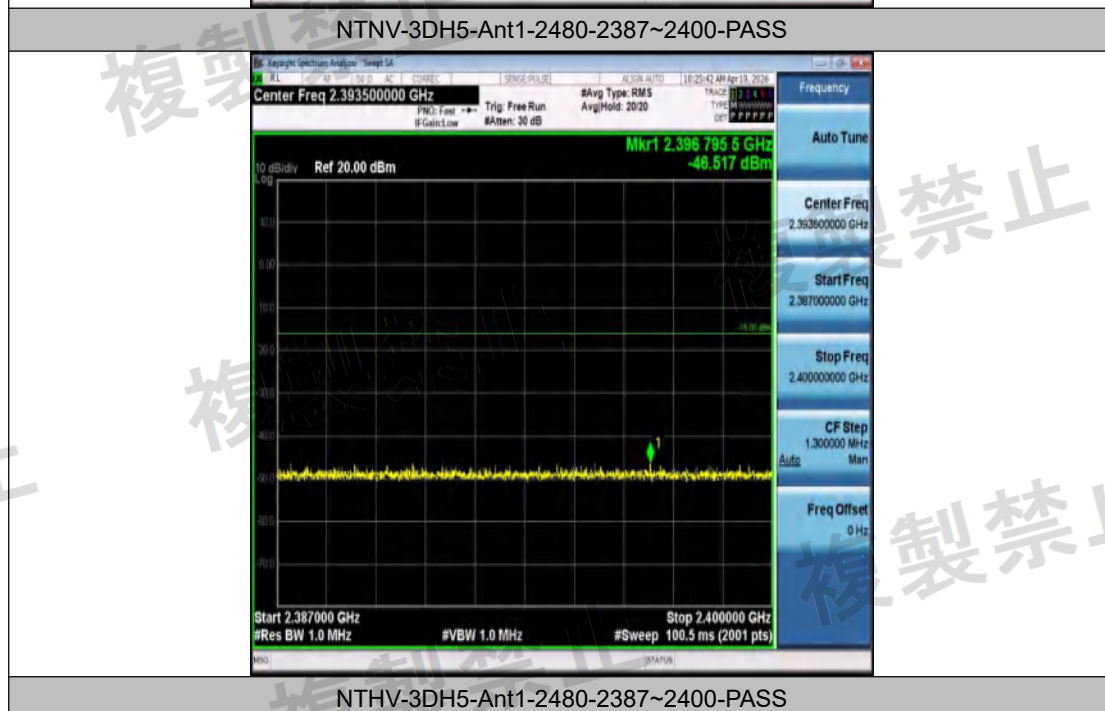

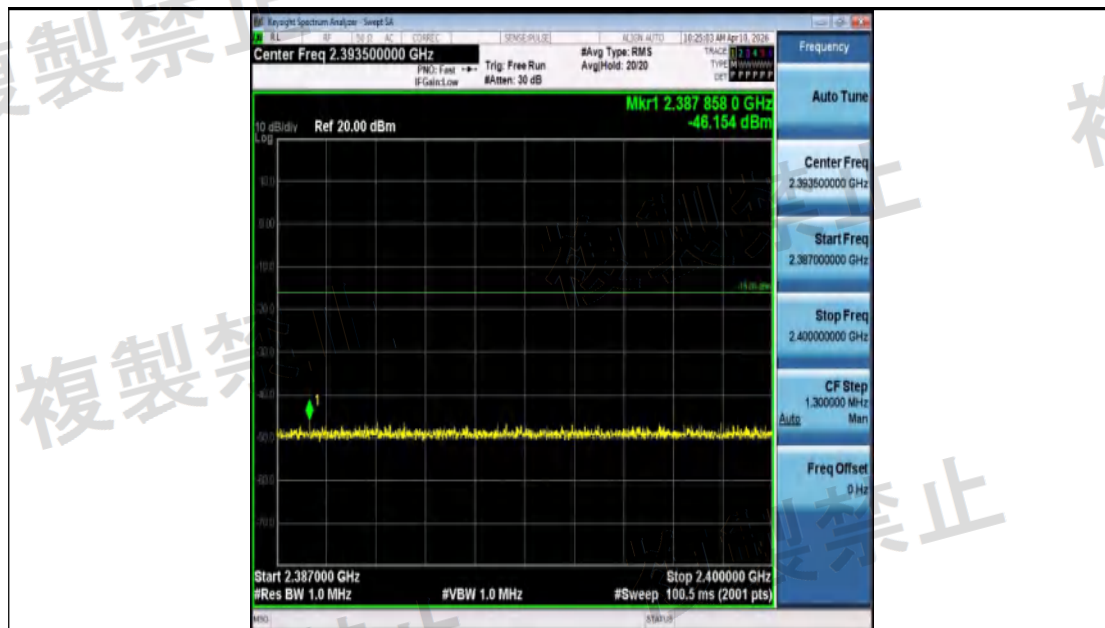

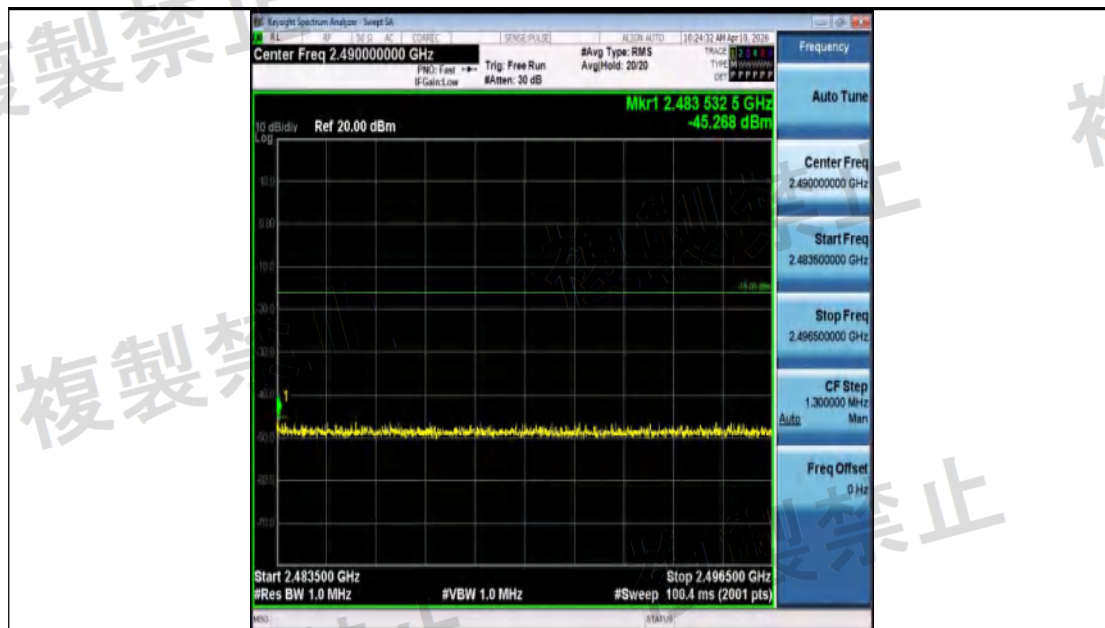



NTLV-3DH5-Ant1-2480-2483.5~2496.5-PASS

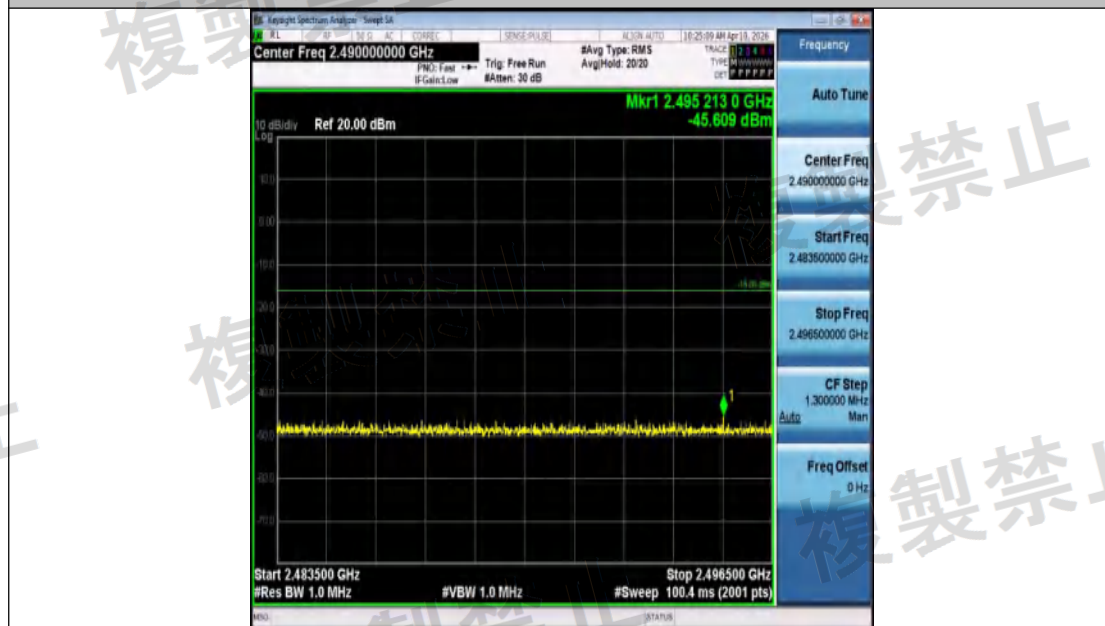


NTNV-3DH5-Ant1-2480-2483.5~2496.5-PASS



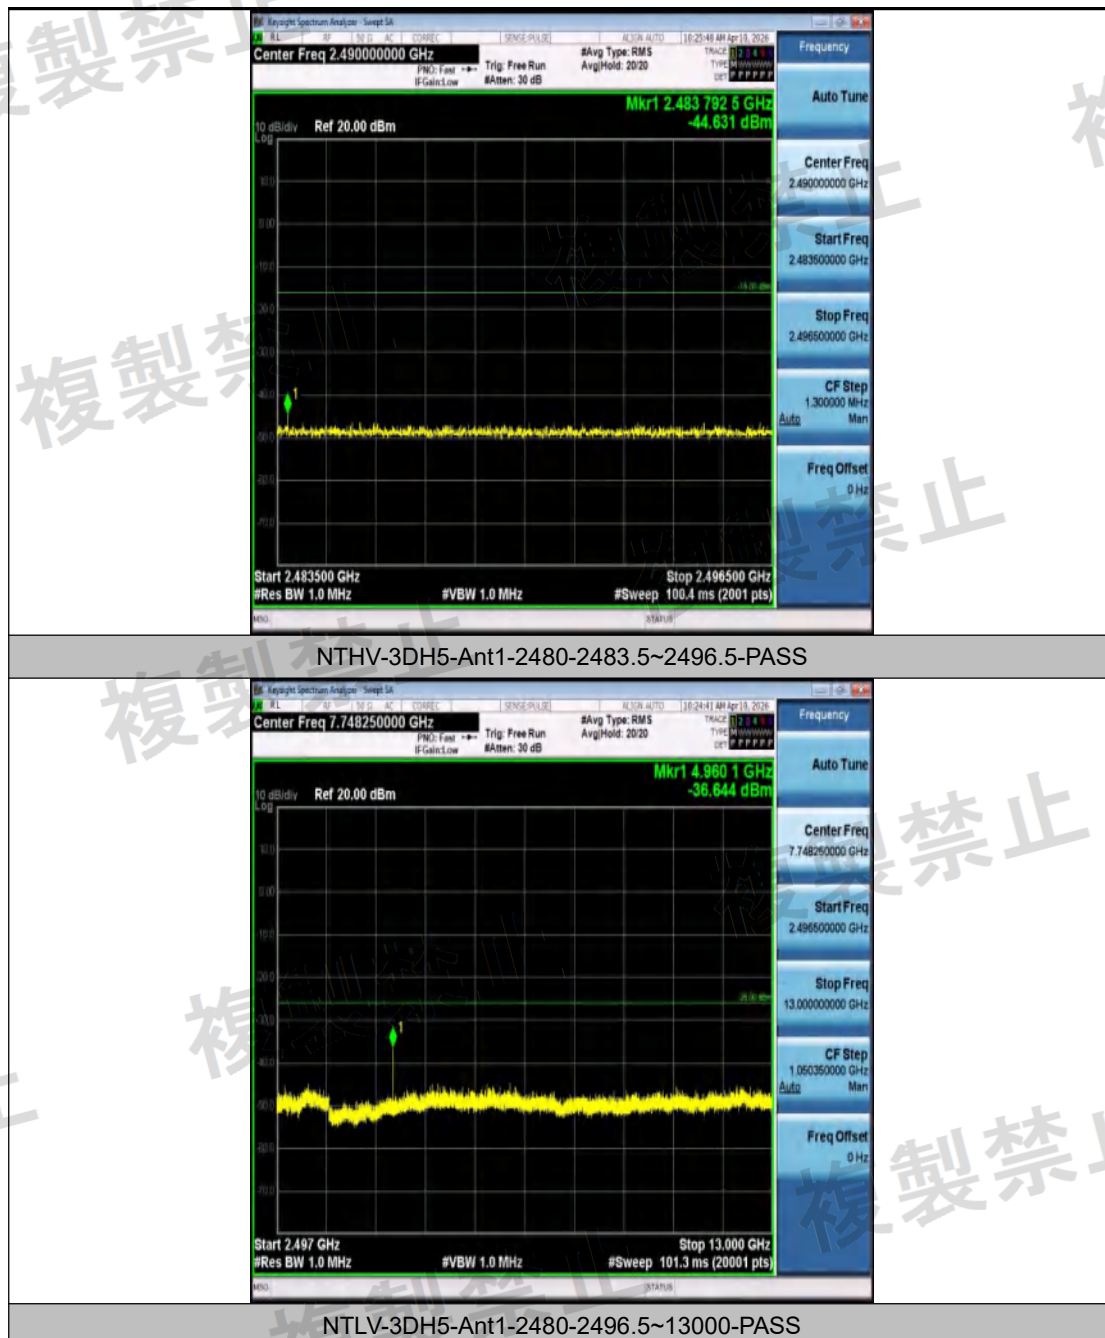

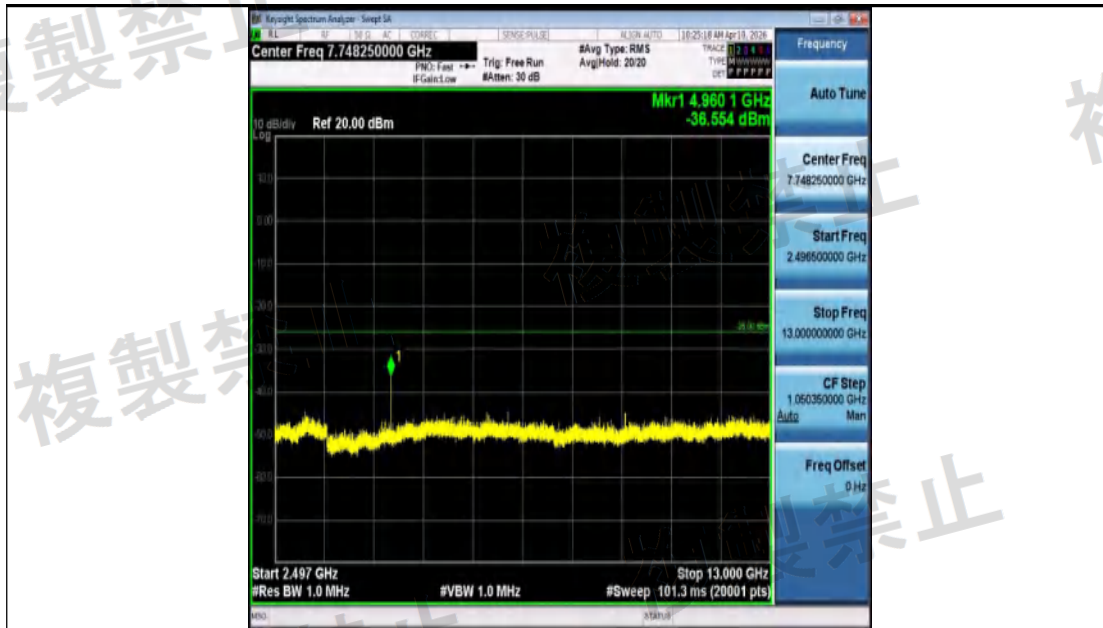

NTNV-3DH5-Ant1-2480-2496.5~13000-PASS

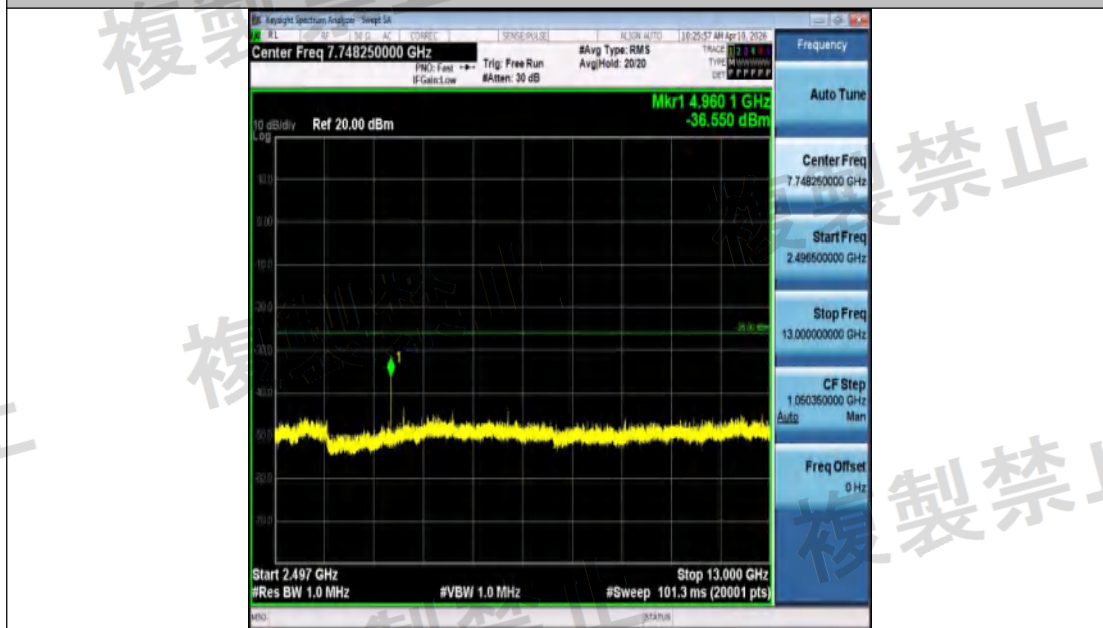

NTHV-3DH5-Ant1-2480-2496.5~13000-PASS



Appendix F: Spurious Emission of RX

Test Result

Test Condition	Test Mode	Antenna	Frequency [MHz]	Freq. Range [MHz]	Freq. [MHz]	Result [dBm]	Limit [dBm]	Result [nW]	Limit [nW]	Verdict
NTLV	DH5	Ant1	2402	30~1000	179.87	-82.43	≤-54	0.00571	≤4	PASS
NTNV	DH5	Ant1	2402	30~1000	203.63	-81.33	≤-54	0.00736	≤4	PASS
NTHV	DH5	Ant1	2402	30~1000	920.46	-82.45	≤-54	0.00569	≤4	PASS
NTLV	DH5	Ant1	2402	1000~12500	2461.08	-50.71	≤-47	8.49180	≤20	See table below
NTNV	DH5	Ant1	2402	1000~12500	2461.08	-52.29	≤-47	5.90201	≤20	See table below
NTHV	DH5	Ant1	2402	1000~12500	2431.18	-57.99	≤-47	1.58855	≤20	PASS
NTLV	DH5	Ant1	2441	30~1000	222.06	-82.27	≤-54	0.00593	≤4	PASS
NTNV	DH5	Ant1	2441	30~1000	209.45	-82.25	≤-54	0.00596	≤4	PASS
NTHV	DH5	Ant1	2441	30~1000	178.90	-82.37	≤-54	0.00579	≤4	PASS
NTLV	DH5	Ant1	2441	1000~12500	2429.45	-61.80	≤-47	0.66069	≤20	PASS
NTNV	DH5	Ant1	2441	1000~12500	2430.03	-62.19	≤-47	0.60395	≤20	PASS
NTHV	DH5	Ant1	2441	1000~12500	2444.4	-49.81	≤-47	10.44720	≤20	See table below
NTLV	DH5	Ant1	2480	30~1000	474.75	-82.32	≤-54	0.00586	≤4	PASS
NTNV	DH5	Ant1	2480	30~1000	196.36	-82.34	≤-54	0.00583	≤4	PASS
NTHV	DH5	Ant1	2480	30~1000	454.86	-82.65	≤-54	0.00543	≤4	PASS
NTLV	DH5	Ant1	2480	1000~12500	2476.60	-58.14	≤-47	1.53462	≤20	PASS
NTNV	DH5	Ant1	2480	1000~12500	2474.88	-61.50	≤-47	0.70795	≤20	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel: (86)0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



NTHV	DH5	Ant1	2480	1000~12500	5175.0 8	-55.26	≤-47	2.9785 2	≤20	See table below
NTLV	2DH5	Ant1	2402	30~1000	220.12	-82.15	≤-54	0.0061 0	≤4	PASS
NTNV	2DH5	Ant1	2402	30~1000	234.67	-81.87	≤-54	0.0065 0	≤4	PASS
NTHV	2DH5	Ant1	2402	30~1000	201.21	-82.04	≤-54	0.0062 5	≤4	PASS
NTLV	2DH5	Ant1	2402	1000~12500	5792.0 5	-48.79	≤-47	13.212 96	≤20	See table below
NTNV	2DH5	Ant1	2402	1000~12500	2443.8 3	-52.36	≤-47	5.8076 4	≤20	See table below
NTHV	2DH5	Ant1	2402	1000~12500	2431.7 5	-57.27	≤-47	1.8749 9	≤20	PASS
NTLV	2DH5	Ant1	2441	30~1000	201.21	-82.73	≤-54	0.0053 3	≤4	PASS
NTNV	2DH5	Ant1	2441	30~1000	876.33	-82.06	≤-54	0.0062 2	≤4	PASS
NTHV	2DH5	Ant1	2441	30~1000	193.93	-82.46	≤-54	0.0056 8	≤4	PASS
NTLV	2DH5	Ant1	2441	1000~12500	2442.6 8	-52.77	≤-47	5.2844 5	≤20	See table below
NTNV	2DH5	Ant1	2441	1000~12500	1752.6 8	-43.34	≤-47	46.344 69	≤20	See table below
NTHV	2DH5	Ant1	2441	1000~12500	2463.3 8	-49.83	≤-47	10.399 20	≤20	See table below
NTLV	2DH5	Ant1	2480	30~1000	513.55	-82.61	≤-54	0.0054 8	≤4	PASS
NTNV	2DH5	Ant1	2480	30~1000	207.03	-82.39	≤-54	0.0057 7	≤4	PASS
NTHV	2DH5	Ant1	2480	30~1000	938.41	-82.50	≤-54	0.0056 2	≤4	PASS
NTLV	2DH5	Ant1	2480	1000~12500	2444.9 8	-55.90	≤-47	2.5704 0	≤20	See table below
NTNV	2DH5	Ant1	2480	1000~12500	1746.9 3	-44.96	≤-47	31.915 38	≤20	See table

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86)0755-26066440 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com



									below
NTHV	2DH5	Ant1	2480	1000~12500	2463.3 8	-52.79	≤-47	5.2601 7	≤20 See table below
NTLV	3DH5	Ant1	2402	30~1000	210.42	-82.34	≤-54	0.0058 3	≤4 PASS
NTNV	3DH5	Ant1	2402	30~1000	229.82	-81.76	≤-54	0.0066 7	≤4 PASS
NTHV	3DH5	Ant1	2402	30~1000	210.42	-81.70	≤-54	0.0067 6	≤4 PASS
NTLV	3DH5	Ant1	2402	1000~12500	1764.1 8	-41.31	≤-47	73.960 53	≤20 See table below
NTNV	3DH5	Ant1	2402	1000~12500	1746.3 5	-53.02	≤-47	4.9888 4	≤20 See table below
NTHV	3DH5	Ant1	2402	1000~12500	2444.9 8	-52.78	≤-47	5.2723 0	≤20 See table below
NTLV	3DH5	Ant1	2441	30~1000	832.68	-59.33	≤-54	1.1668 1	≤4 See table below
NTNV	3DH5	Ant1	2441	30~1000	825.40	-64.34	≤-54	0.3681 3	≤4 PASS
NTHV	3DH5	Ant1	2441	30~1000	148.34	-82.48	≤-54	0.0056 5	≤4 PASS
NTLV	3DH5	Ant1	2441	1000~12500	2461.6 5	-51.13	≤-47	7.7090 3	≤20 See table below
NTNV	3DH5	Ant1	2441	1000~12500	2443.2 5	-51.61	≤-47	6.9024 0	≤20 See table below
NTHV	3DH5	Ant1	2441	1000~12500	2444.4	-50.83	≤-47	8.2603 8	≤20 See table below
NTLV	3DH5	Ant1	2480	30~1000	974.78	-82.41	≤-54	0.0057 4	≤4 PASS
NTNV	3DH5	Ant1	2480	30~1000	444.19	-82.92	≤-54	0.00511	≤4 PASS
NTHV	3DH5	Ant1	2480	30~1000	198.30	-82.37	≤-54	0.0057 9	≤4 PASS
NTLV	3DH5	Ant1	2480	1000~12500	2460.5	-50.15	≤-47	9.6605 1	≤20 See table below

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86)0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



NTNV	3DH5	Ant1	2480	1000~12500	5793.7 8	-65.73	≤-47	0.2673 0	≤20	PASS
NTHV	3DH5	Ant1	2480	1000~12500	2461.6 5	-54.68	≤-47	3.4040 8	≤20	See table below

Test Result_Step2

Test Condition	Test Mode	Antenna	Frequency [MHz]	Freq. [MHz]	Result [dBm]	Limit [dBm]	Result [nW]	Limit [nW]	Verdict
NTLV	DH5	Ant1	2402	2461.08	-68.12	≤-47	0.1541 7	≤20	PASS
NTNV	DH5	Ant1	2402	2461.08	-65.00	≤-47	0.3162 3	≤20	PASS
NTHV	DH5	Ant1	2441	2444.40	-69.30	≤-47	0.11749	≤20	PASS
NTHV	DH5	Ant1	2480	5175.08	-84.95	≤-47	0.0032 0	≤20	PASS
NTLV	2DH5	Ant1	2402	5792.05	-58.89	≤-47	1.2912 2	≤20	PASS
NTNV	2DH5	Ant1	2402	2443.83	-58.51	≤-47	1.4092 9	≤20	PASS
NTLV	2DH5	Ant1	2441	2442.68	-63.25	≤-47	0.4731 5	≤20	PASS
NTNV	2DH5	Ant1	2441	1752.68	-91.31	≤-47	0.0007 4	≤20	PASS
NTNV	2DH5	Ant1	2441	2444.98	-59.86	≤-47	1.0327 6	≤20	PASS
NTNV	2DH5	Ant1	2441	2461.08	-53.11	≤-47	4.8865 2	≤20	PASS
NTHV	2DH5	Ant1	2441	2463.38	-68.71	≤-47	0.1345 9	≤20	PASS
NTLV	2DH5	Ant1	2480	2444.98	-75.04	≤-47	0.0313 3	≤20	PASS
NTNV	2DH5	Ant1	2480	1746.93	-49.95	≤-47	10.1157 9	≤20	PASS
NTNV	2DH5	Ant1	2480	2443.83	-72.86	≤-47	0.0517 6	≤20	PASS
NTHV	2DH5	Ant1	2480	2443.83	-61.02	≤-47	0.7906 8	≤20	PASS
NTHV	2DH5	Ant1	2480	2463.38	-69.20	≤-47	0.1202 3	≤20	PASS
NTLV	3DH5	Ant1	2402	1746.35	-57.03	≤-47	1.9815 3	≤20	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



NTLV	3DH5	Ant1	2402	1764.18	-59.21	≤-47	1.1995 0	≤20	PASS
NTLV	3DH5	Ant1	2402	2444.40	-56.54	≤-47	2.2182 0	≤20	PASS
NTLV	3DH5	Ant1	2402	2463.38	-78.00	≤-47	0.0158 5	≤20	PASS
NTNV	3DH5	Ant1	2402	1746.35	-91.29	≤-47	0.0007 4	≤20	PASS
NTNV	3DH5	Ant1	2402	1761.30	-53.22	≤-47	4.7643 1	≤20	PASS
NTNV	3DH5	Ant1	2402	2444.40	-62.85	≤-47	0.5188 0	≤20	PASS
NTNV	3DH5	Ant1	2402	2462.23	-74.22	≤-47	0.0378 4	≤20	PASS
NTNV	3DH5	Ant1	2402	5793.20	-60.78	≤-47	0.8356 0	≤20	PASS
NTHV	3DH5	Ant1	2402	2444.98	-87.19	≤-47	0.0019 1	≤20	PASS
NTHV	3DH5	Ant1	2402	2461.65	-76.85	≤-47	0.0206 5	≤20	PASS
NTHV	3DH5	Ant1	2402	5780.55	-60.80	≤-47	0.8317 6	≤20	PASS
NTLV	3DH5	Ant1	2441	832.68	-69.54	≤-54	0.11117	≤4	PASS
NTLV	3DH5	Ant1	2441	2461.65	-61.51	≤-47	0.7063 2	≤20	PASS
NTNV	3DH5	Ant1	2441	1764.75	-91.29	≤-47	0.0007 4	≤20	PASS
NTNV	3DH5	Ant1	2441	2443.25	-72.61	≤-47	0.0548 3	≤20	PASS
NTHV	3DH5	Ant1	2441	2444.40	-78.81	≤-47	0.0131 5	≤20	PASS
NTHV	3DH5	Ant1	2441	2463.95	-59.77	≤-47	1.0543 9	≤20	PASS
NTHV	3DH5	Ant1	2441	5175.08	-82.08	≤-47	0.0061 9	≤20	PASS
NTLV	3DH5	Ant1	2480	2444.40	-61.61	≤-47	0.6902 4	≤20	PASS
NTLV	3DH5	Ant1	2480	2460.50	-71.71	≤-47	0.0674 5	≤20	PASS
NTLV	3DH5	Ant1	2480	5176.23	-66.93	≤-47	0.2027 7	≤20	PASS
NTHV	3DH5	Ant1	2480	2461.65	-78.03	≤-47	0.0157 4	≤20	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86)0755-26066440 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com





Test Graphs

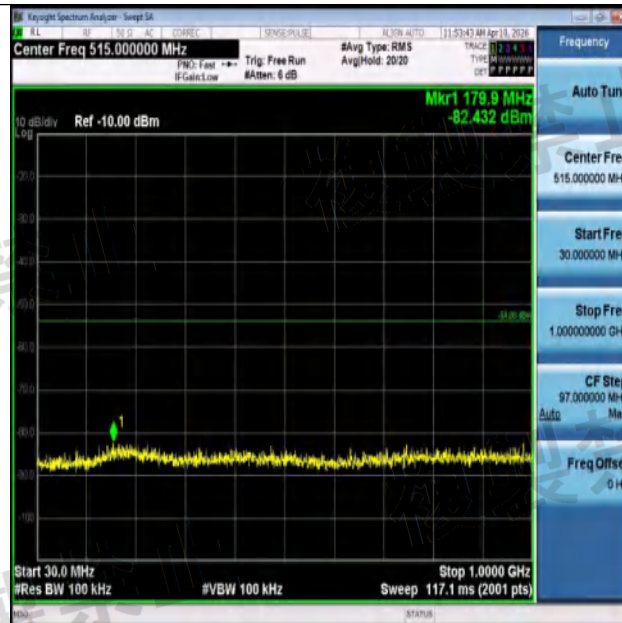


NTLV-DH5-Ant1-2402-30~1000-PASS




NTVN-DH5-Ant1-2402-30~1000-PASS



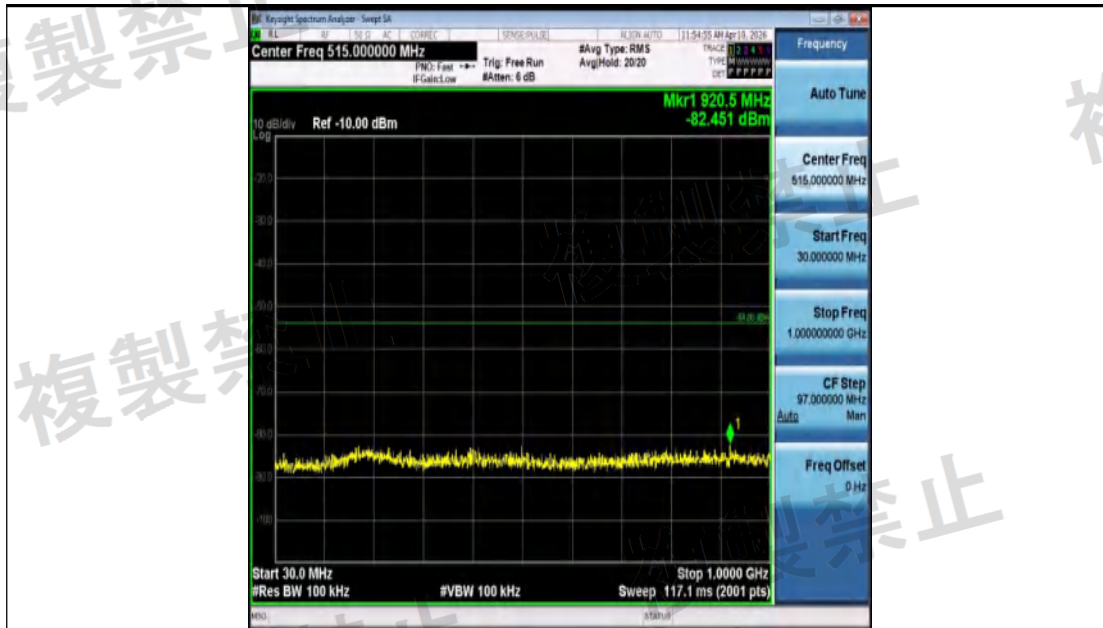


NTHV-DH5-Ant1-2402-30~1000-PASS

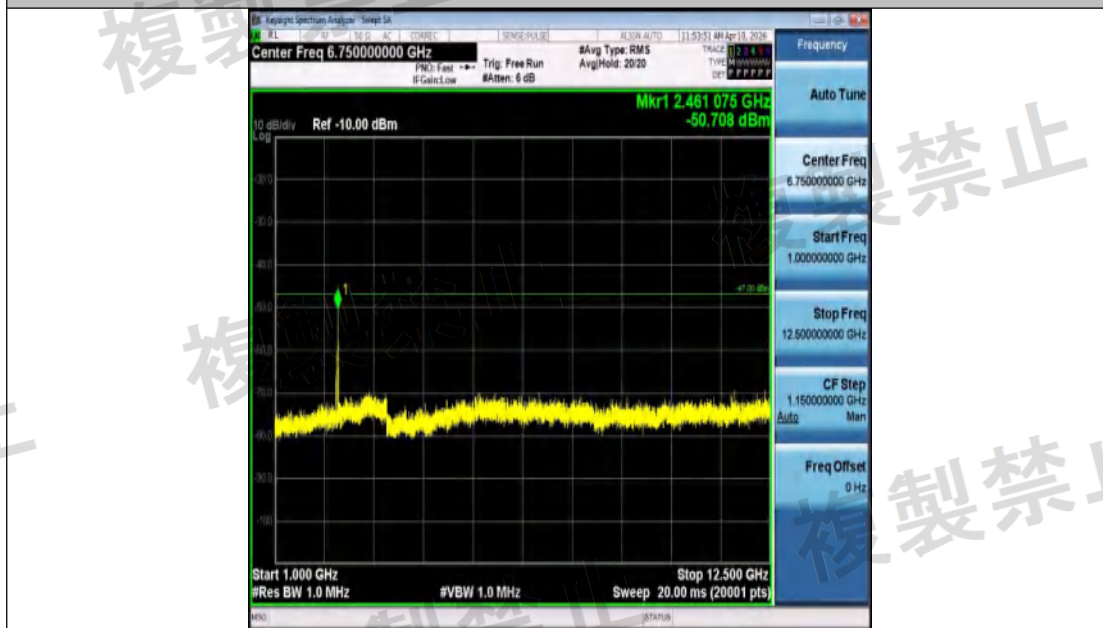


NTLV-DH5-Ant1-2402-1000~12500-See table below



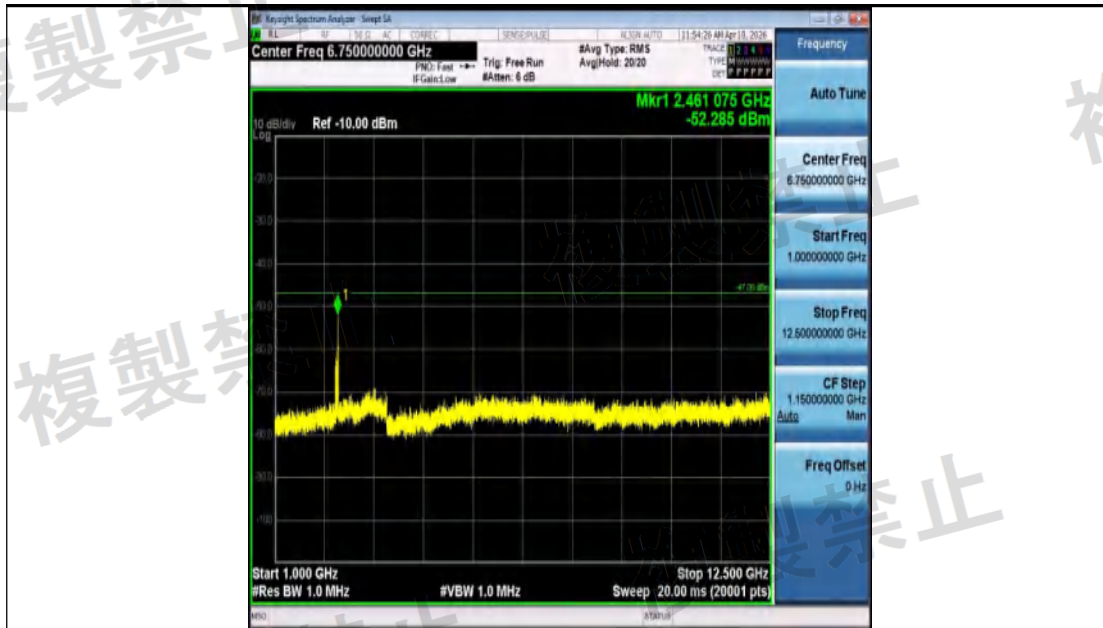


NTNV-DH5-Ant1-2402-1000~12500-See table below

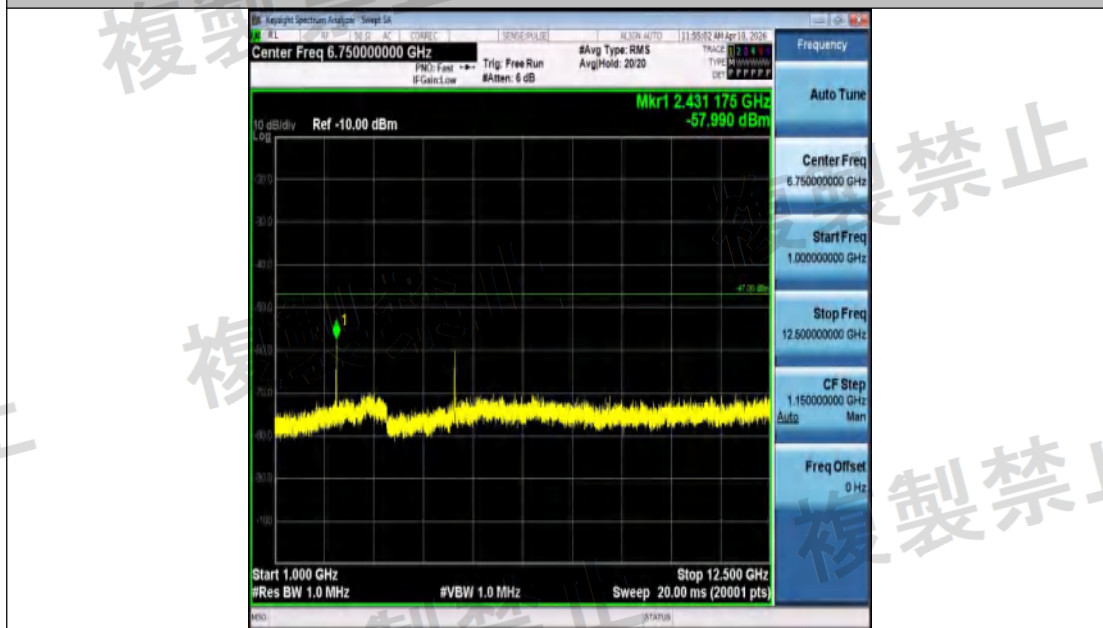


NTHV-DH5-Ant1-2402-1000~12500-PASS



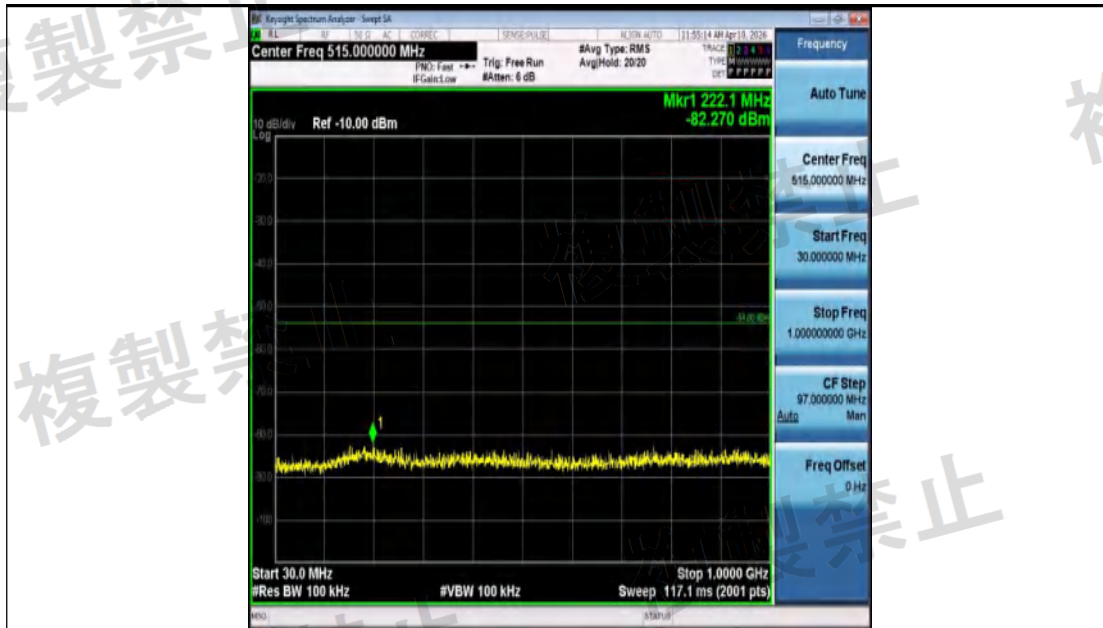


NTLV-DH5-Ant1-2441-30~1000-PASS

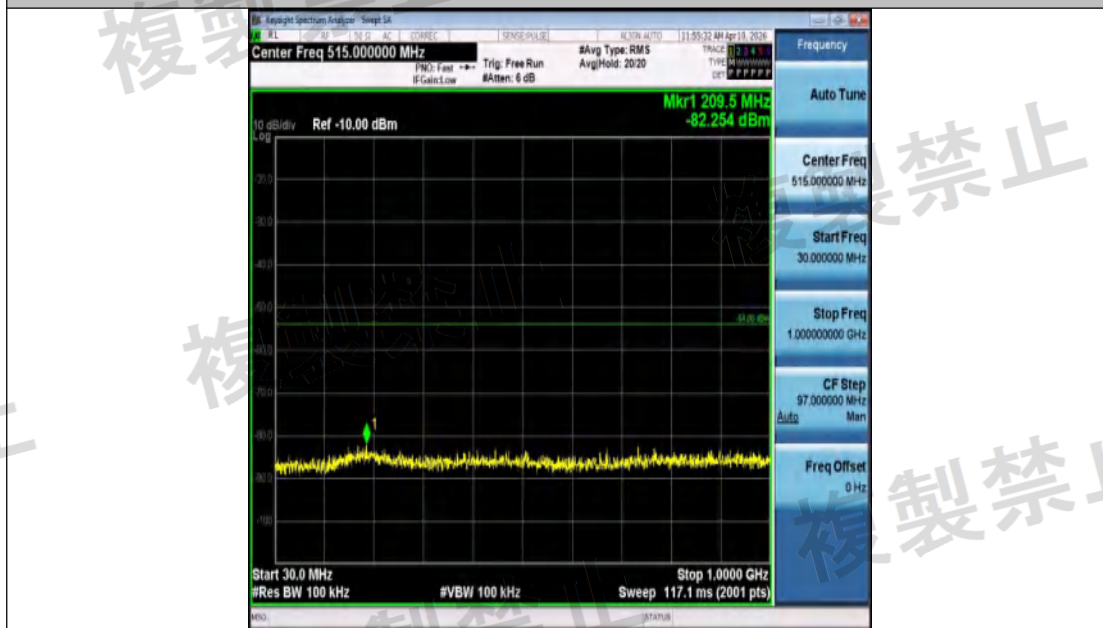


NTNV-DH5-Ant1-2441-30~1000-PASS




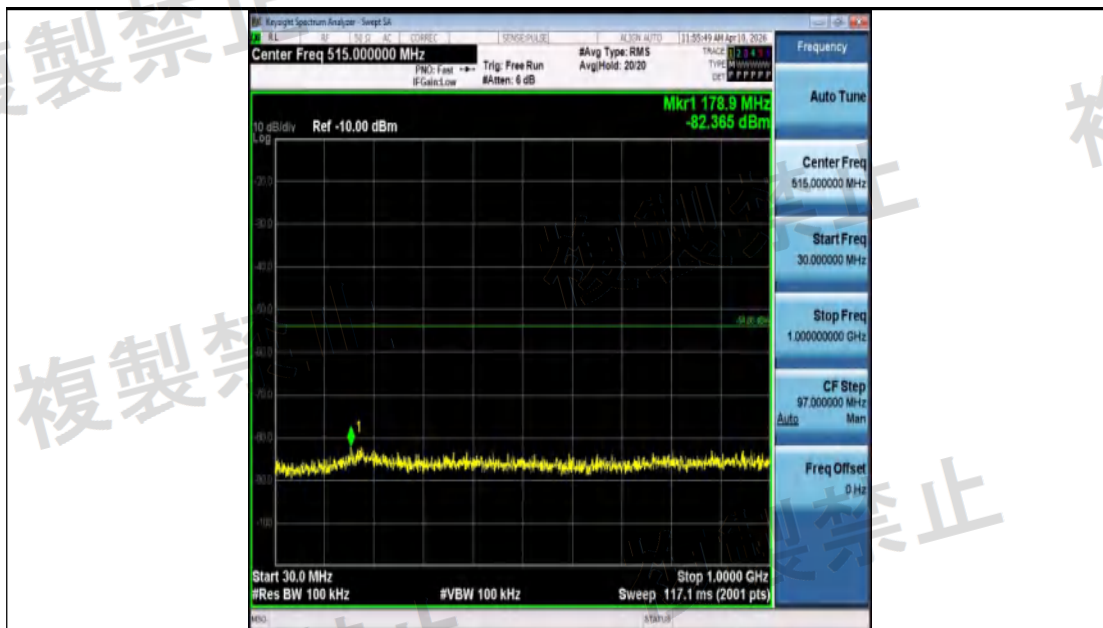




NTHV-DH5-Ant1-2441-30~1000-PASS

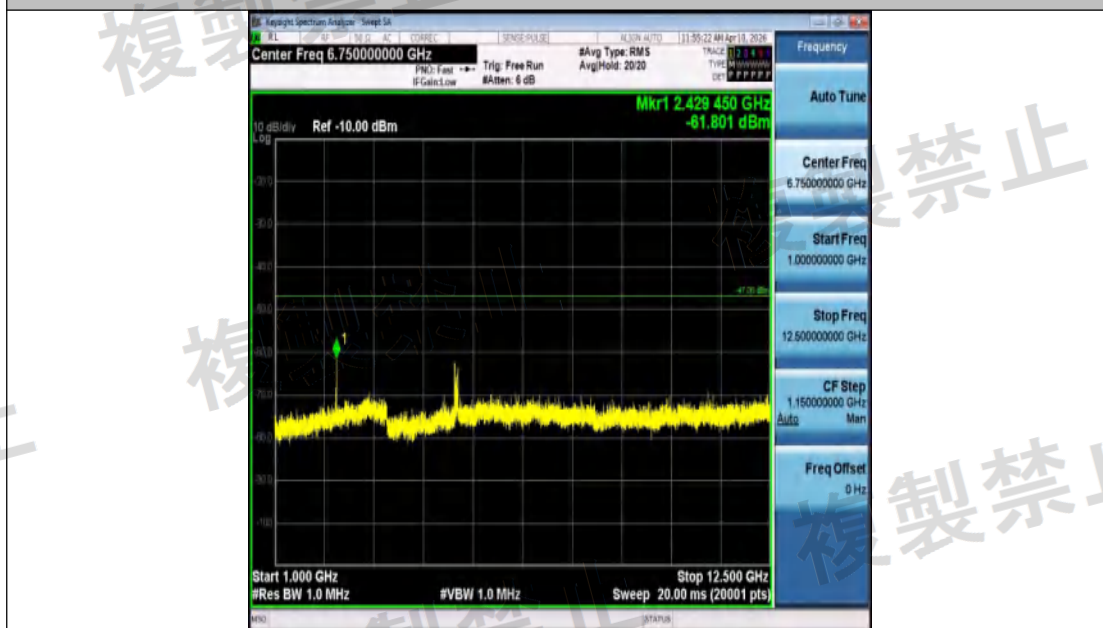




NTLV-DH5-Ant1-2441-1000~12500-PASS




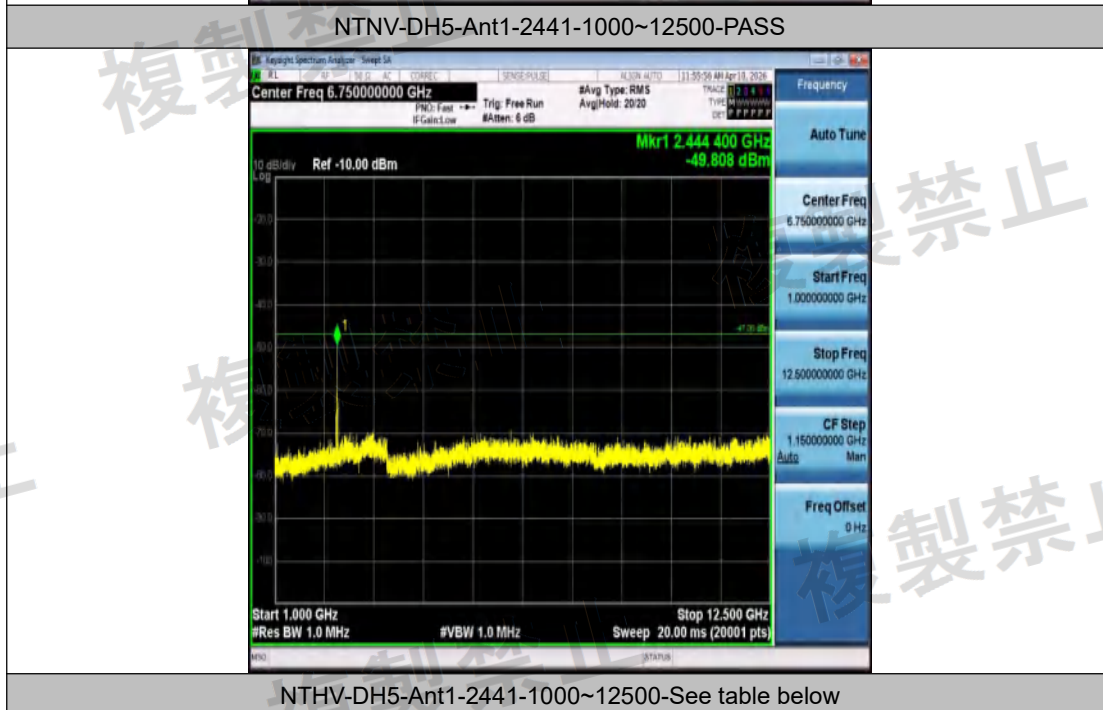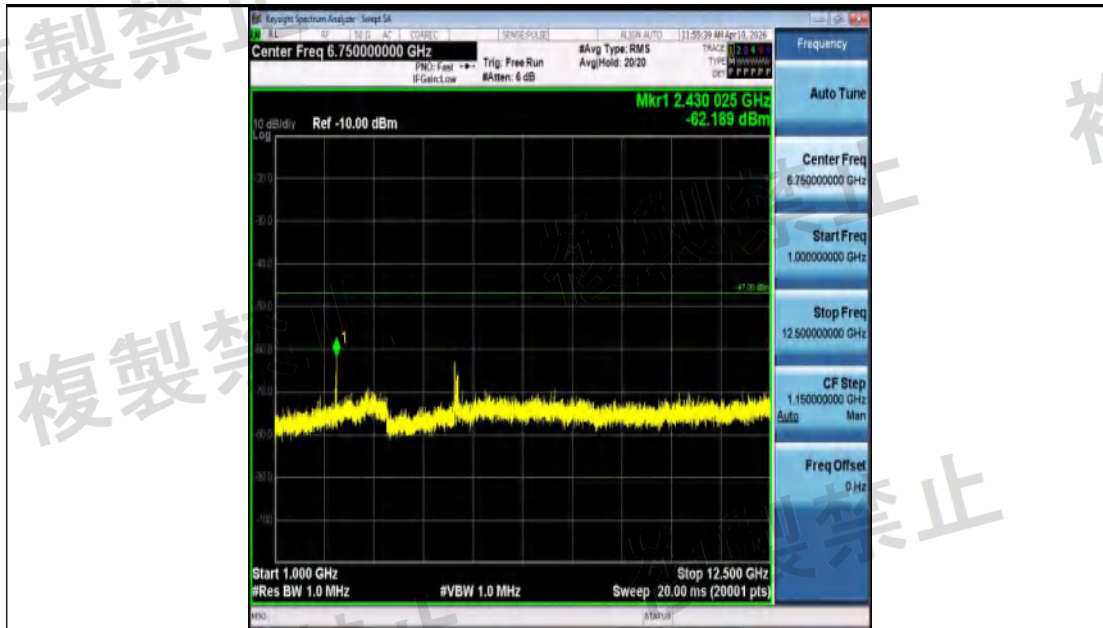

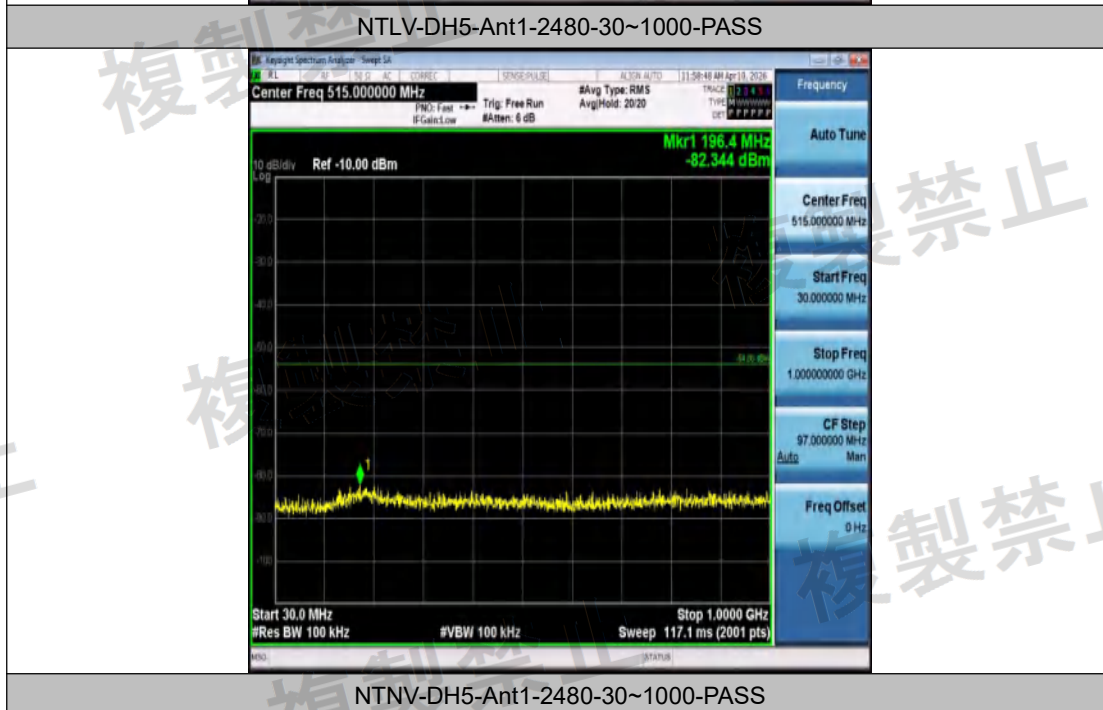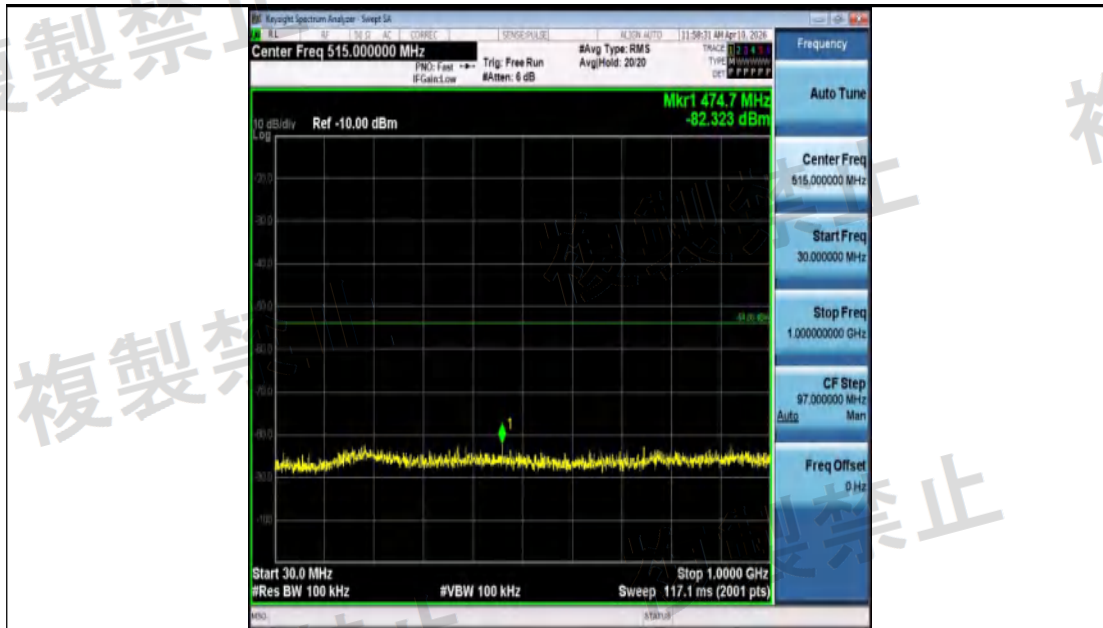


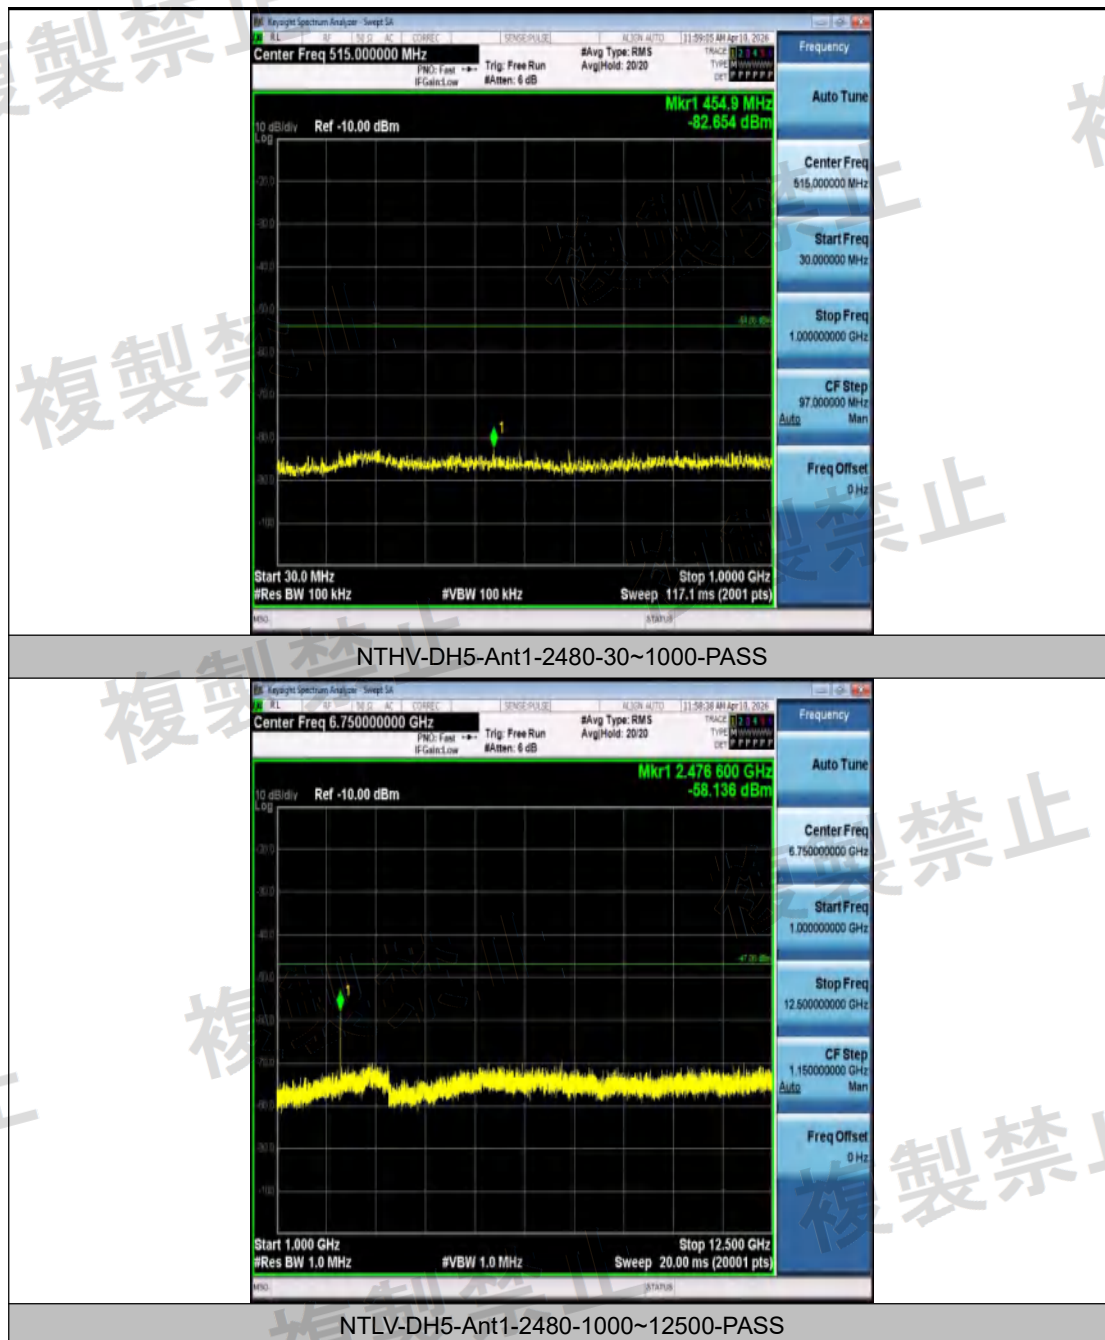

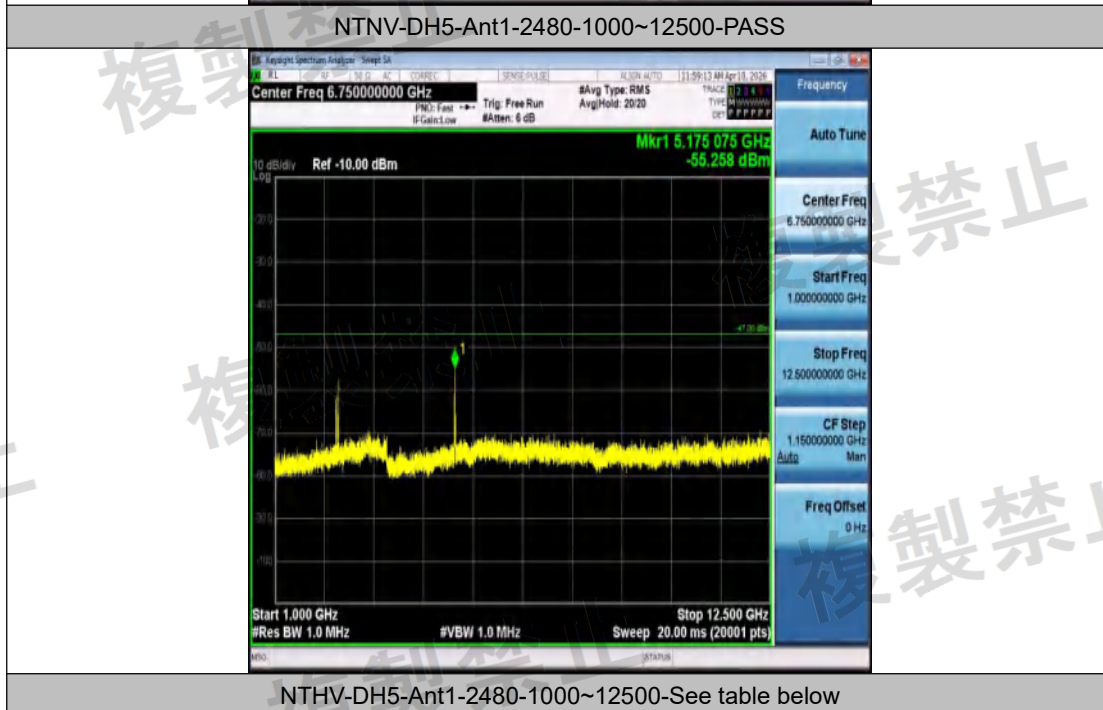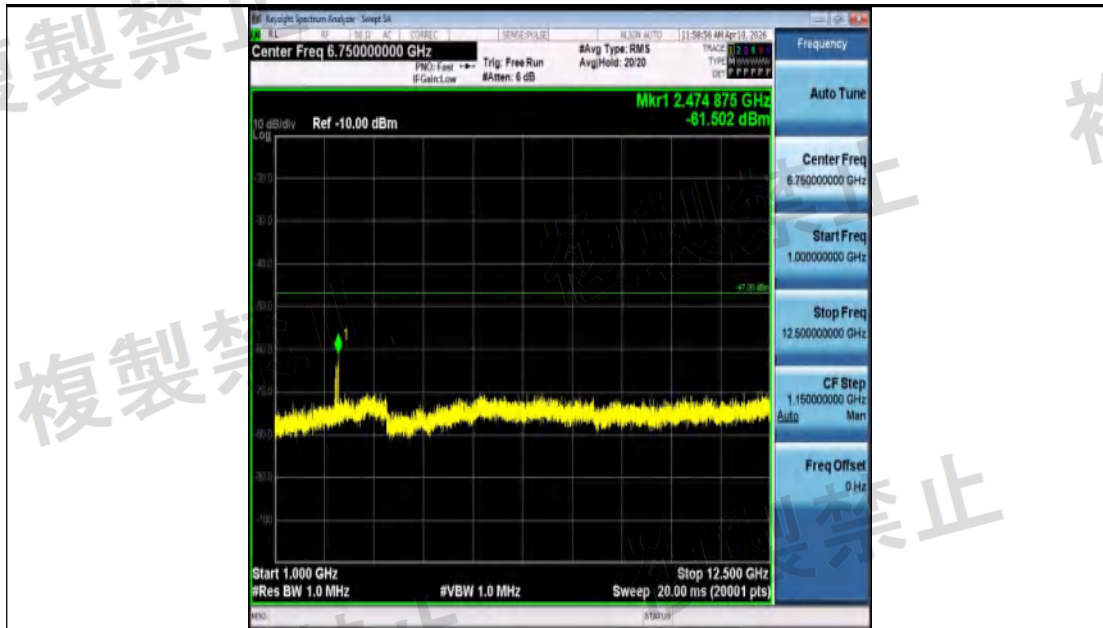

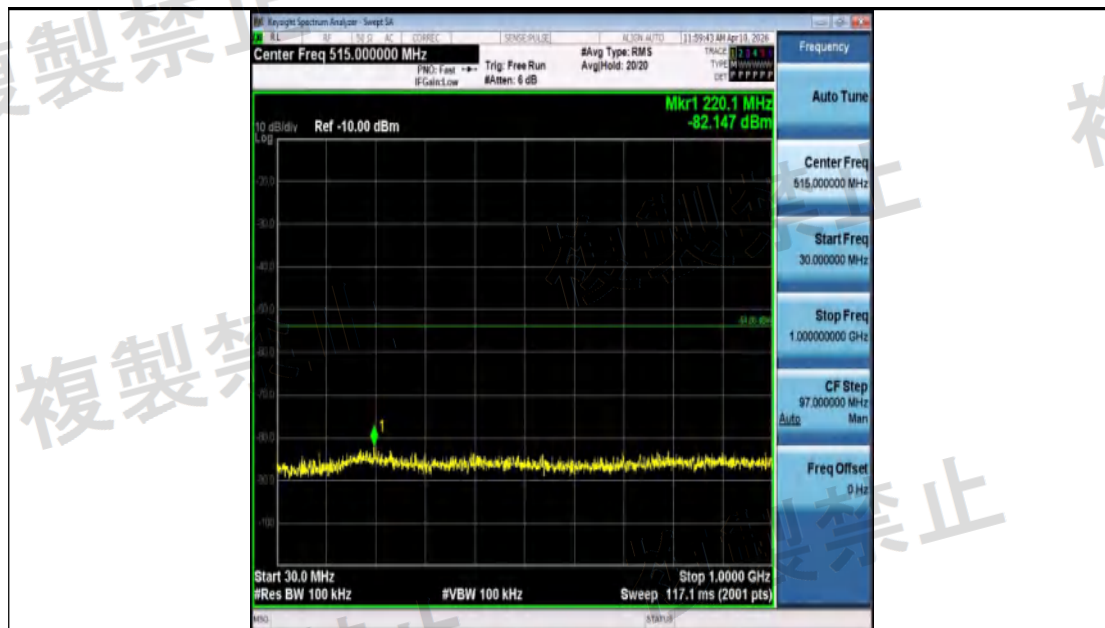


NTLV-2DH5-Ant1-2402-30~1000-PASS

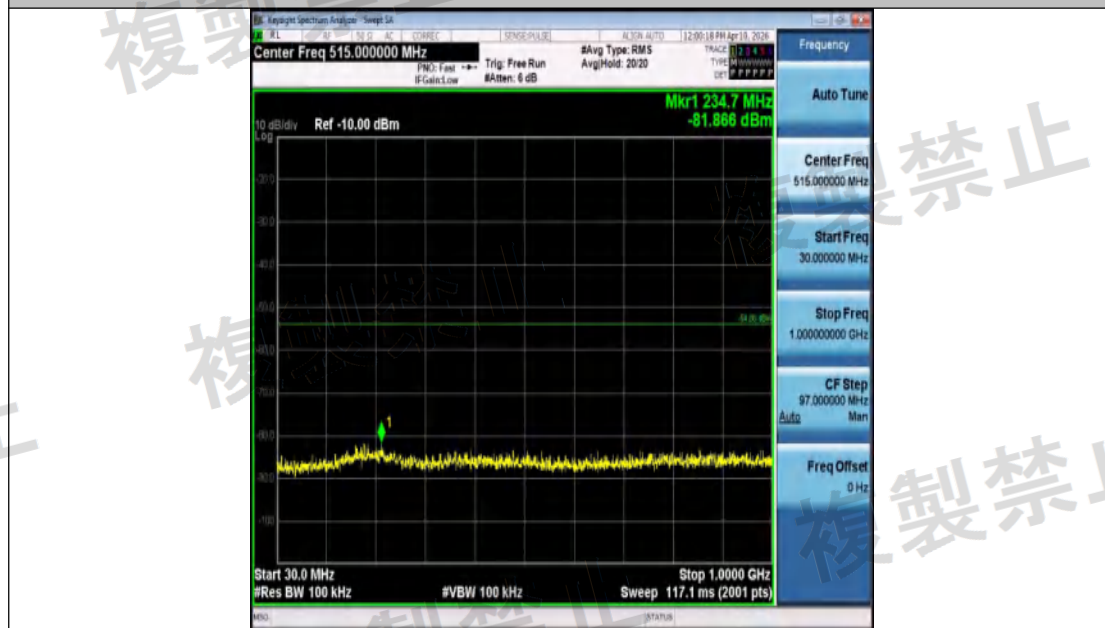


NTNV-2DH5-Ant1-2402-30~1000-PASS



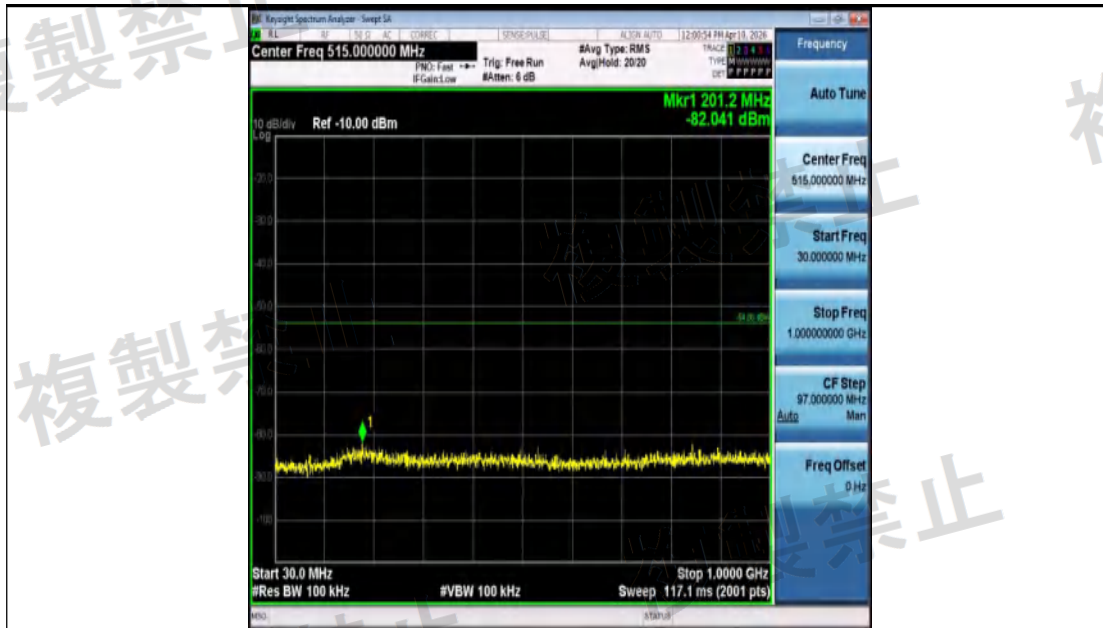


NTHV-2DH5-Ant1-2402-30~1000-PASS

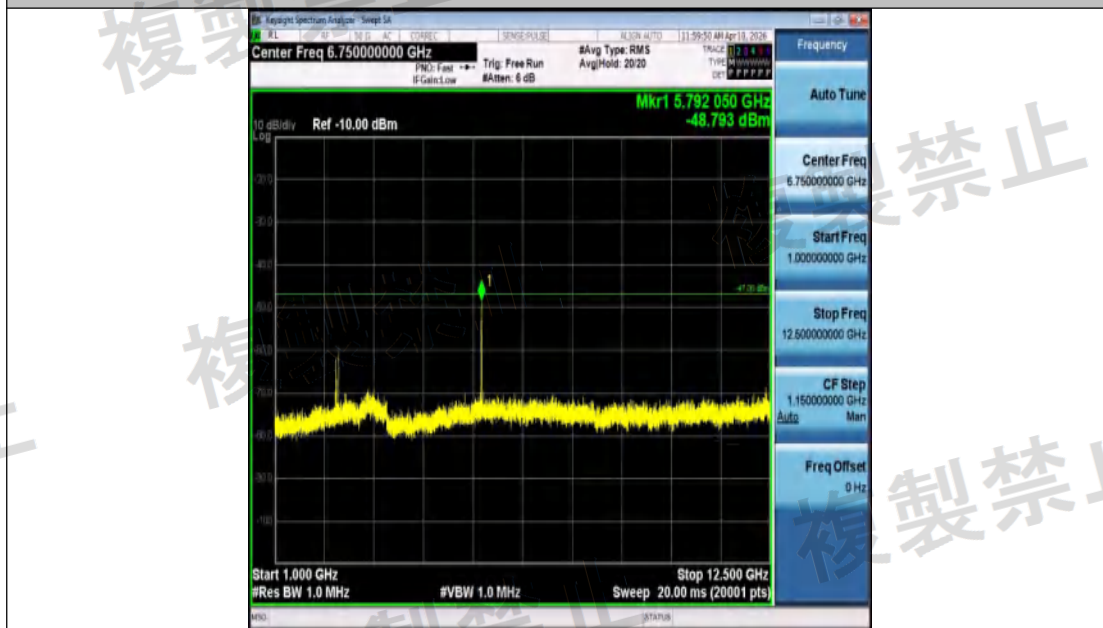


NTLV-2DH5-Ant1-2402-1000~12500-See table below



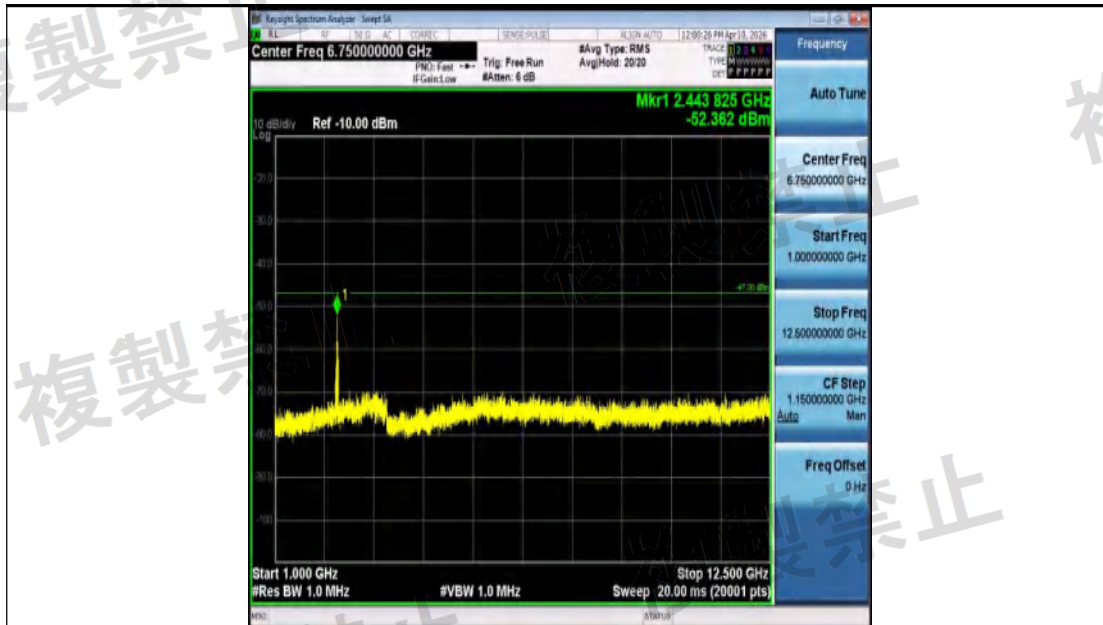


NTNV-2DH5-Ant1-2402-1000~12500-See table below

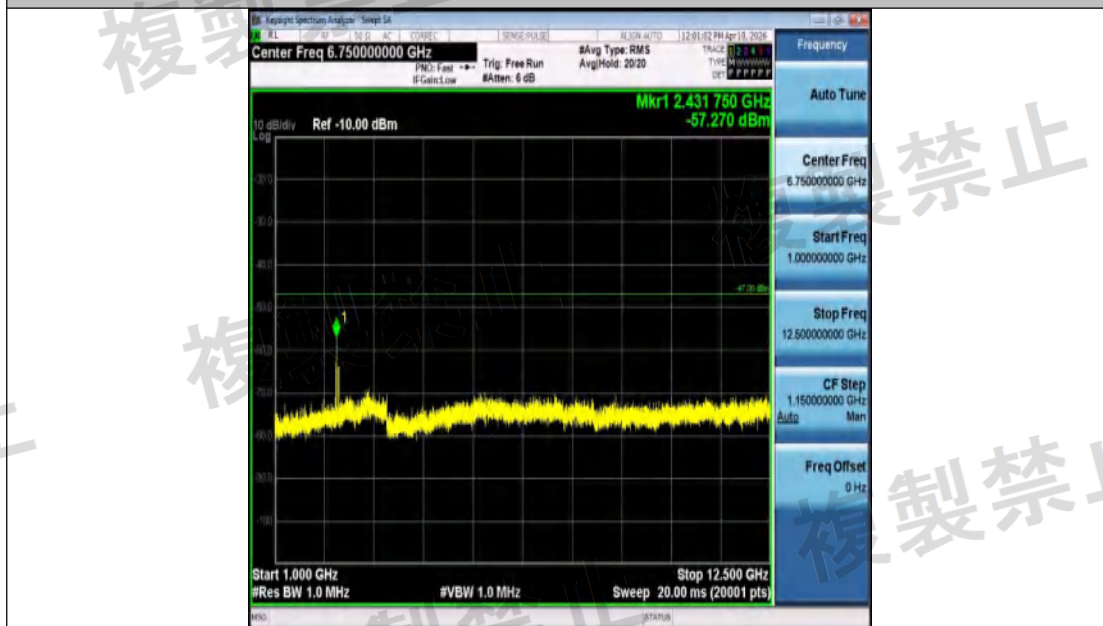


NTHV-2DH5-Ant1-2402-1000~12500-PASS



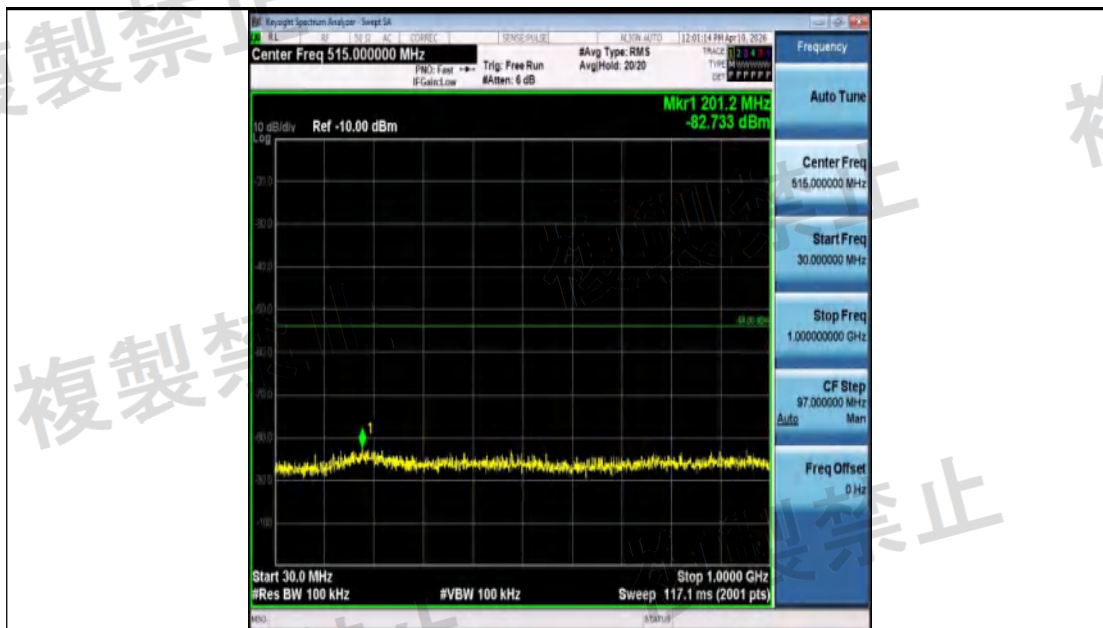


NTLV-2DH5-Ant1-2441-30~1000-PASS

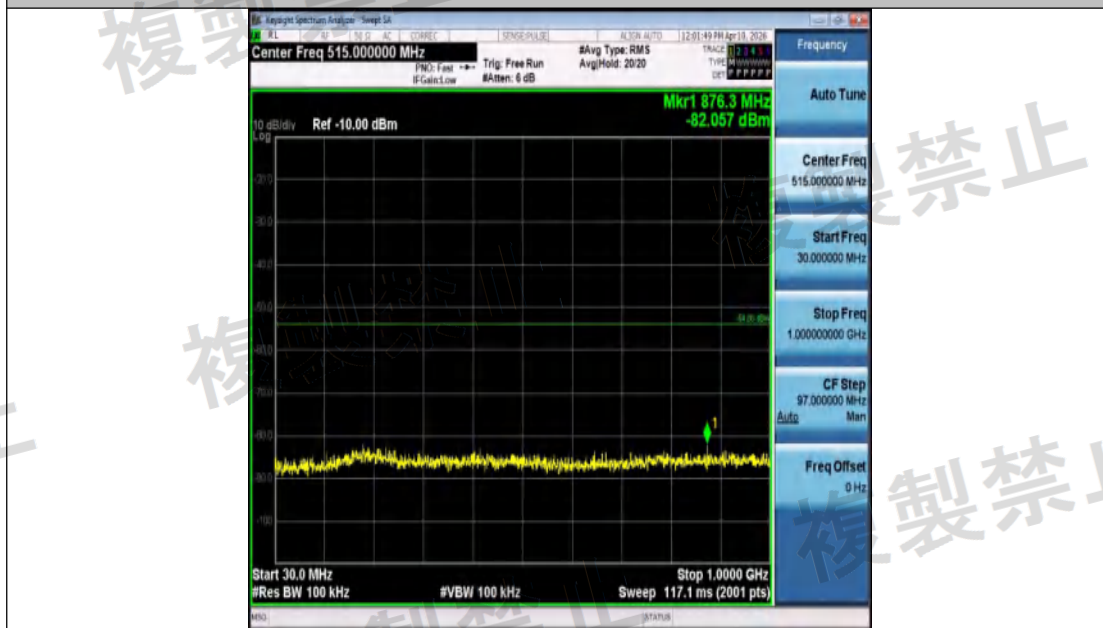


NTNV-2DH5-Ant1-2441-30~1000-PASS




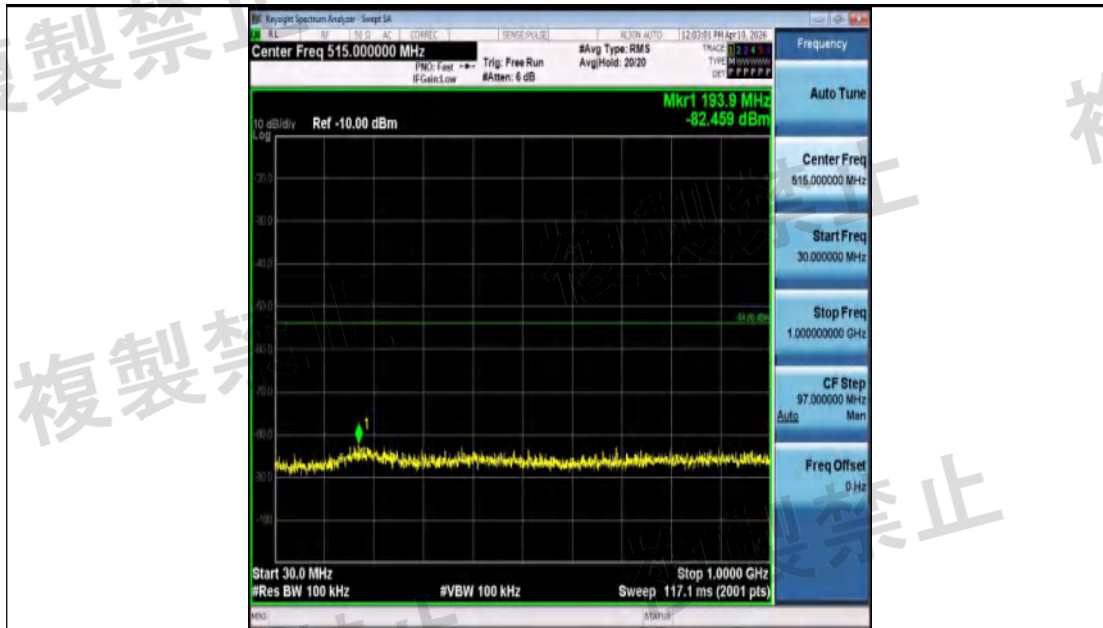



NTHV-2DH5-Ant1-2441-30~1000-PASS

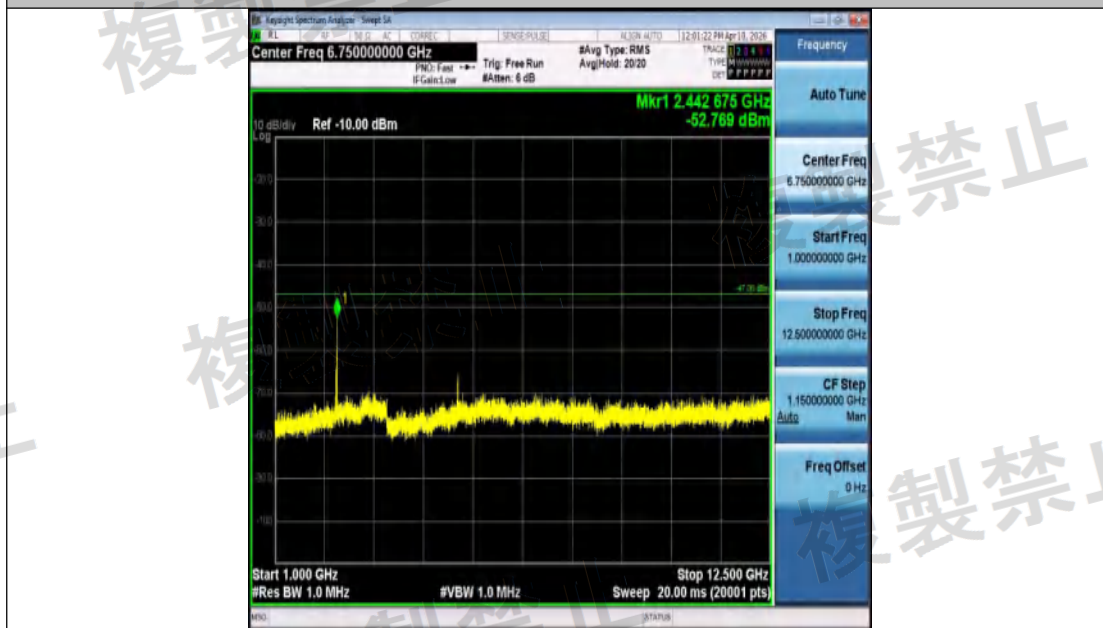


NTLV-2DH5-Ant1-2441-1000~12500-See table below



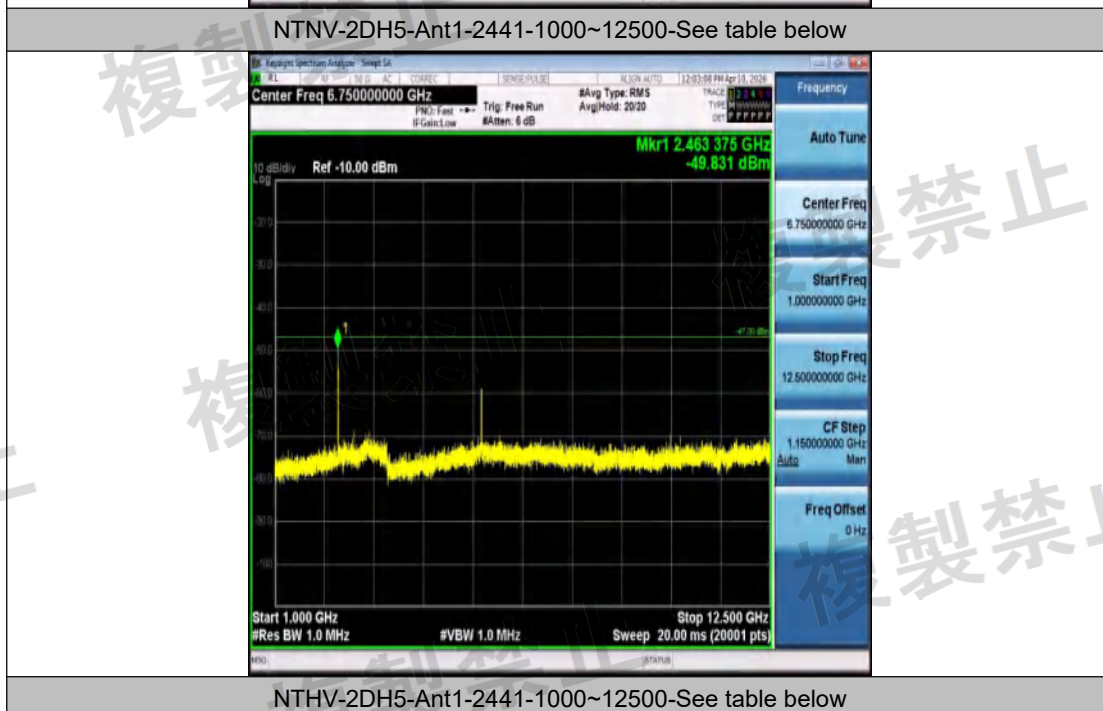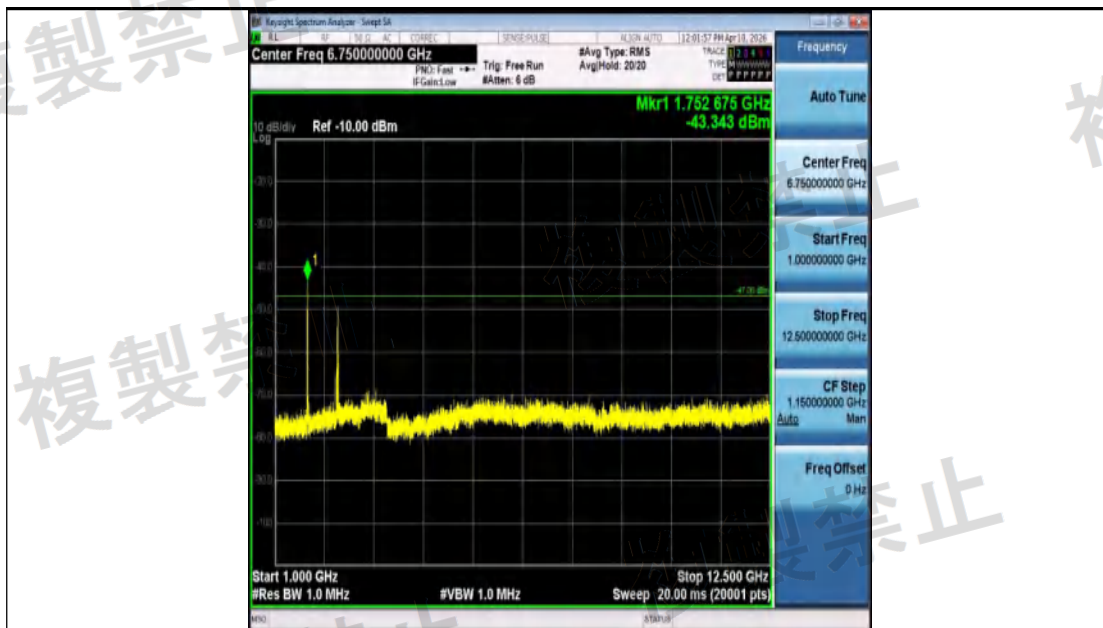

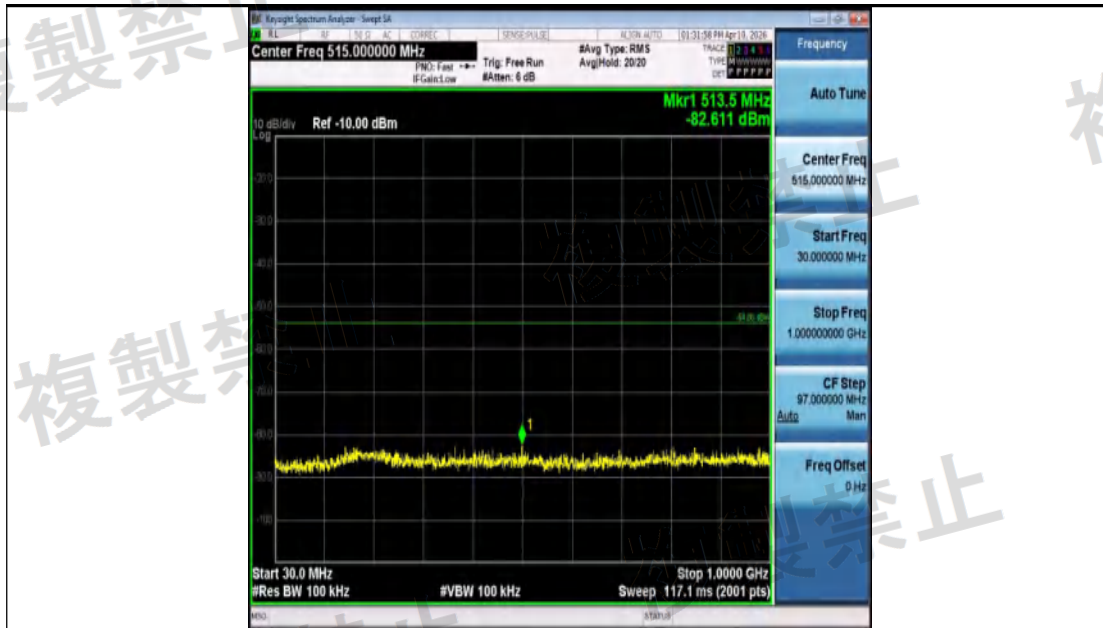


NTLV-2DH5-Ant1-2480-30~1000-PASS

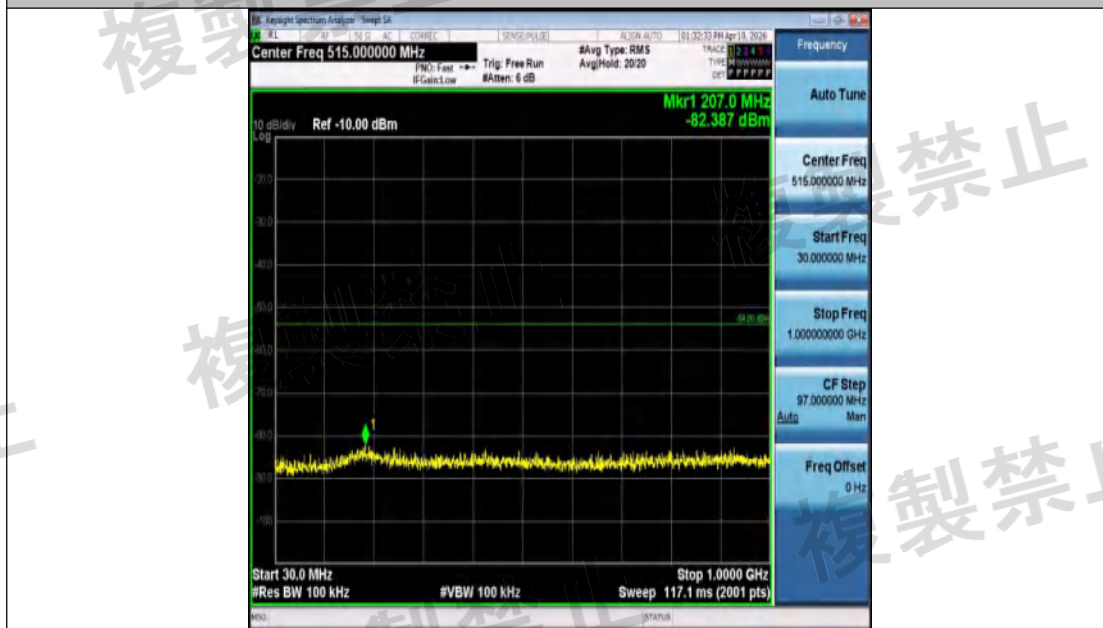


NTNV-2DH5-Ant1-2480-30~1000-PASS



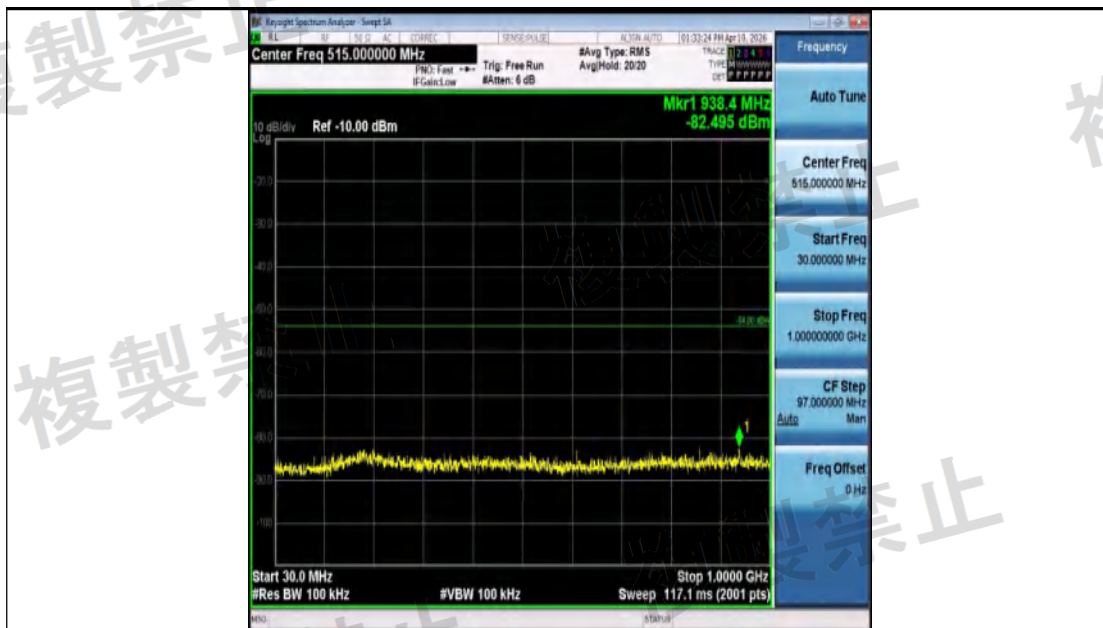


NTHV-2DH5-Ant1-2480-30~1000-PASS

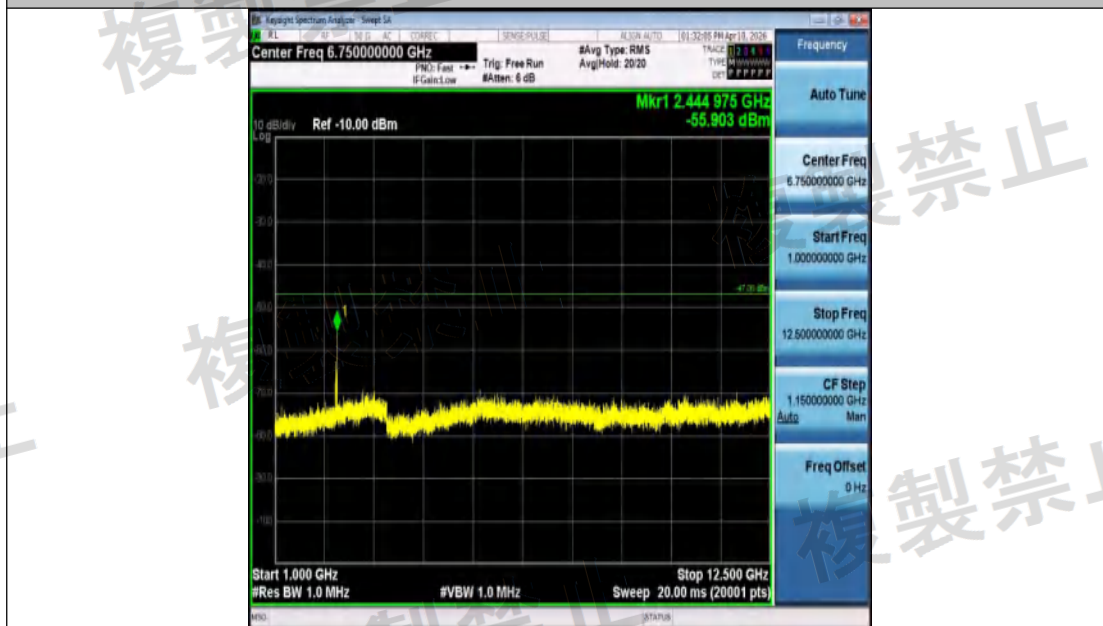


NTLV-2DH5-Ant1-2480-1000~12500-See table below




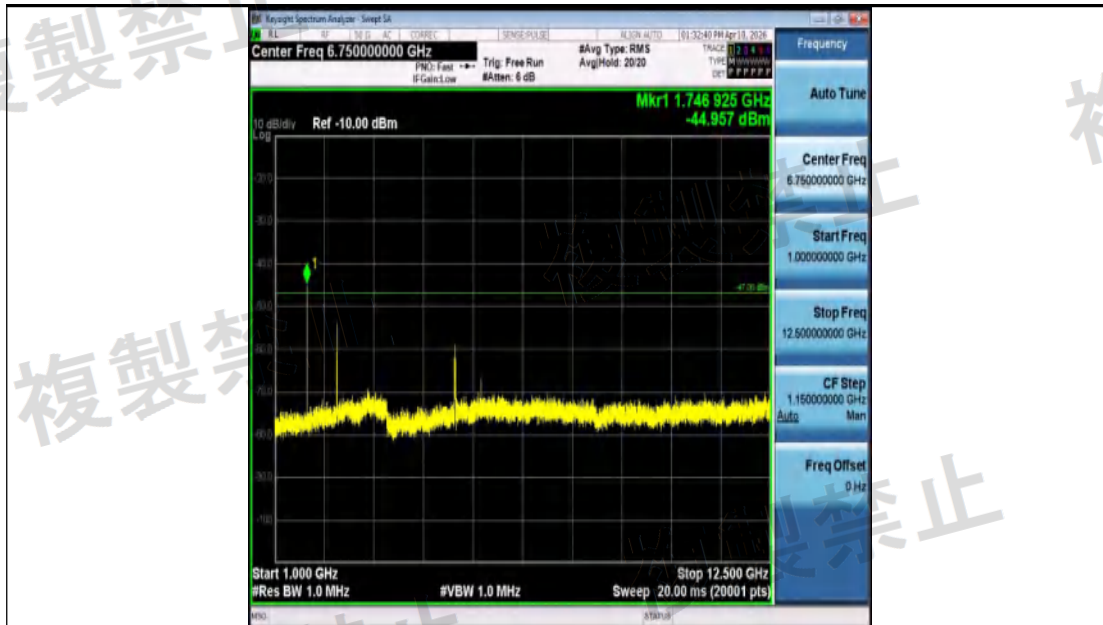



NTN-2DH5-Ant1-2480-1000~12500-See table below

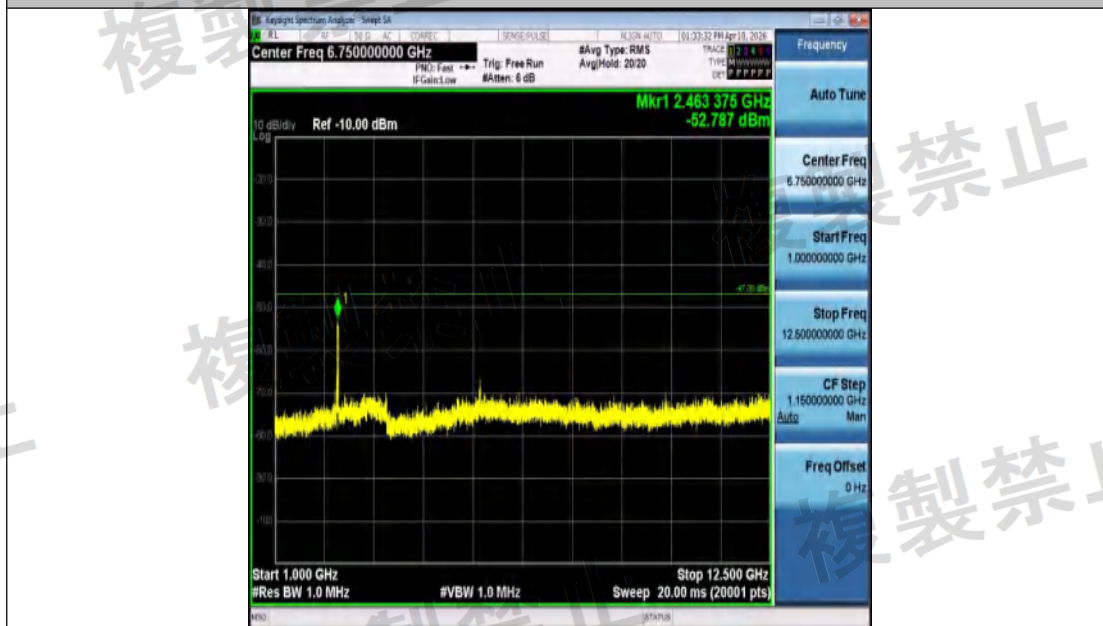


NTHV-2DH5-Ant1-2480-1000~12500-See table below



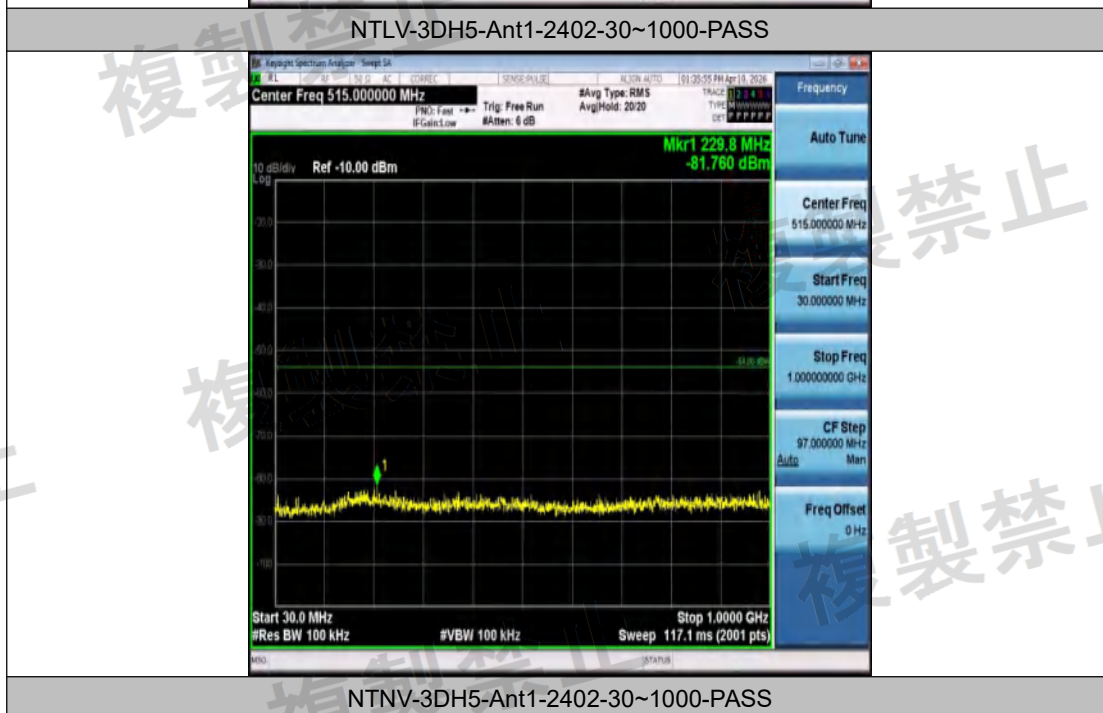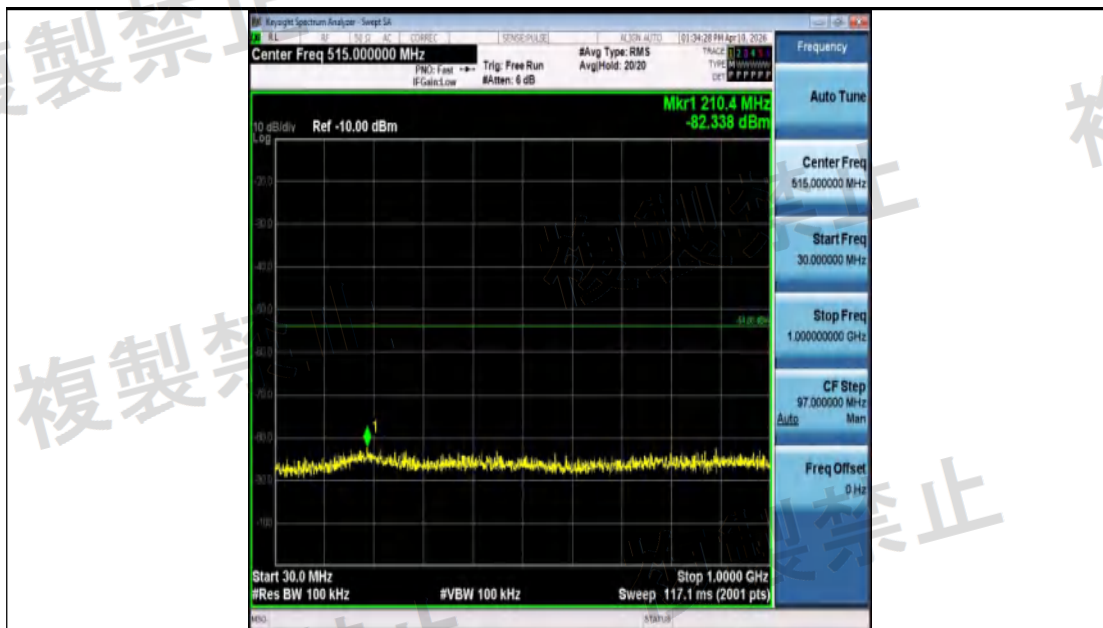

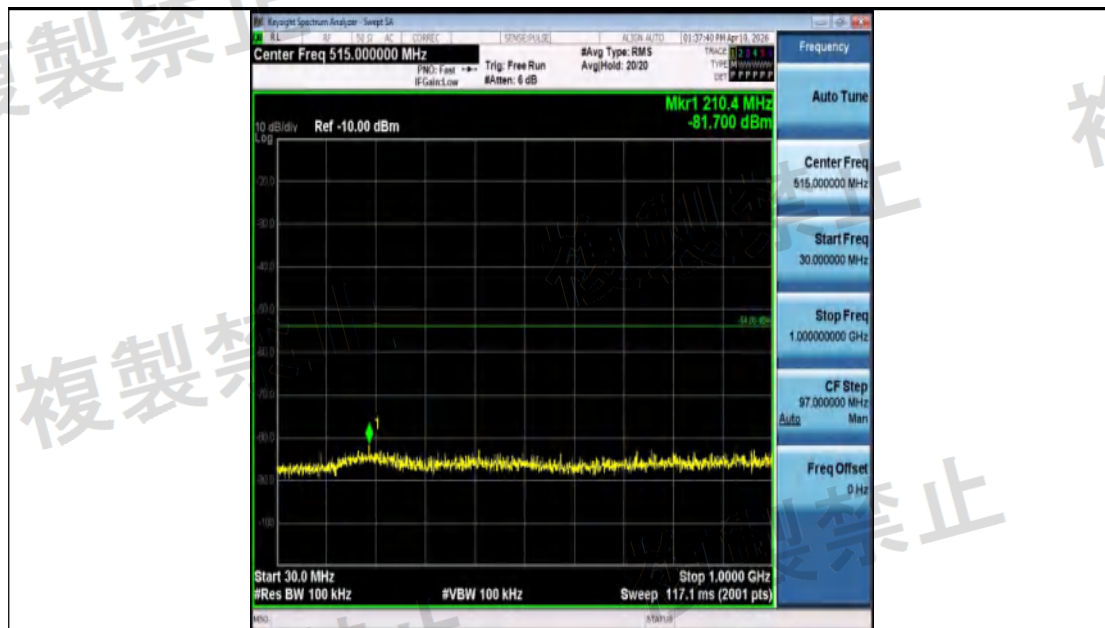


NTHV-3DH5-Ant1-2402-30~1000-PASS

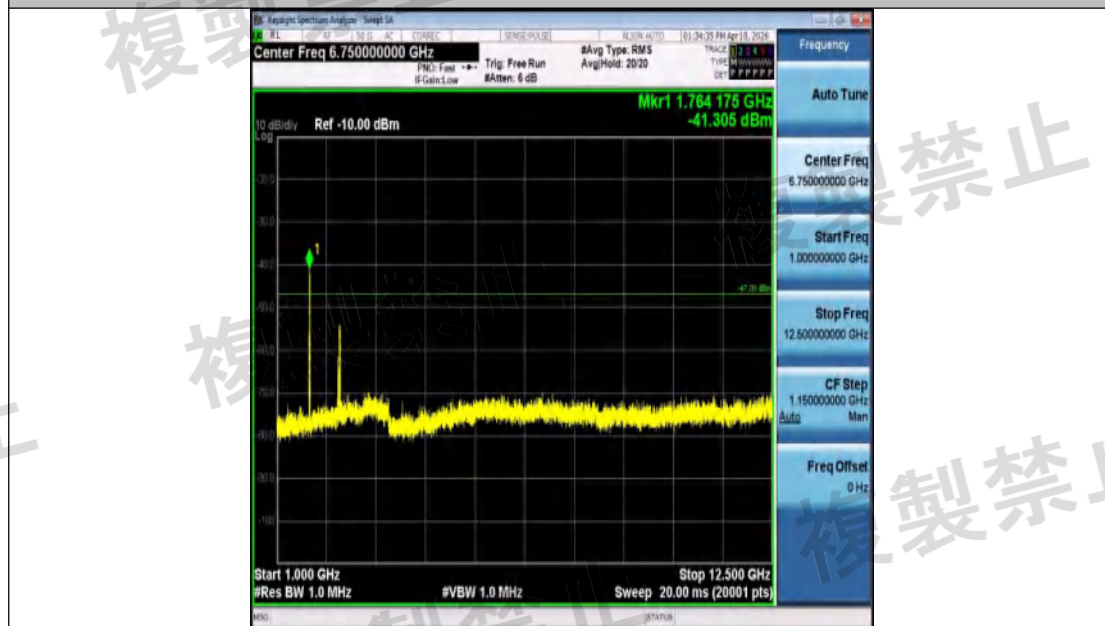


NTLV-3DH5-Ant1-2402-1000~12500-See table below




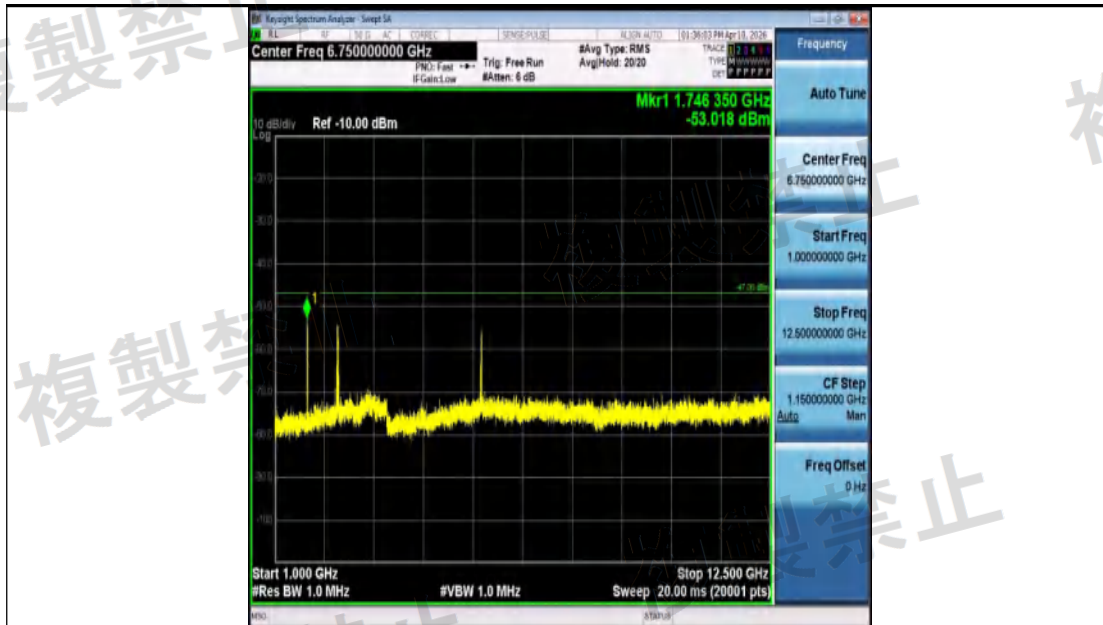



NTN-3DH5-Ant1-2402-1000~12500-See table below

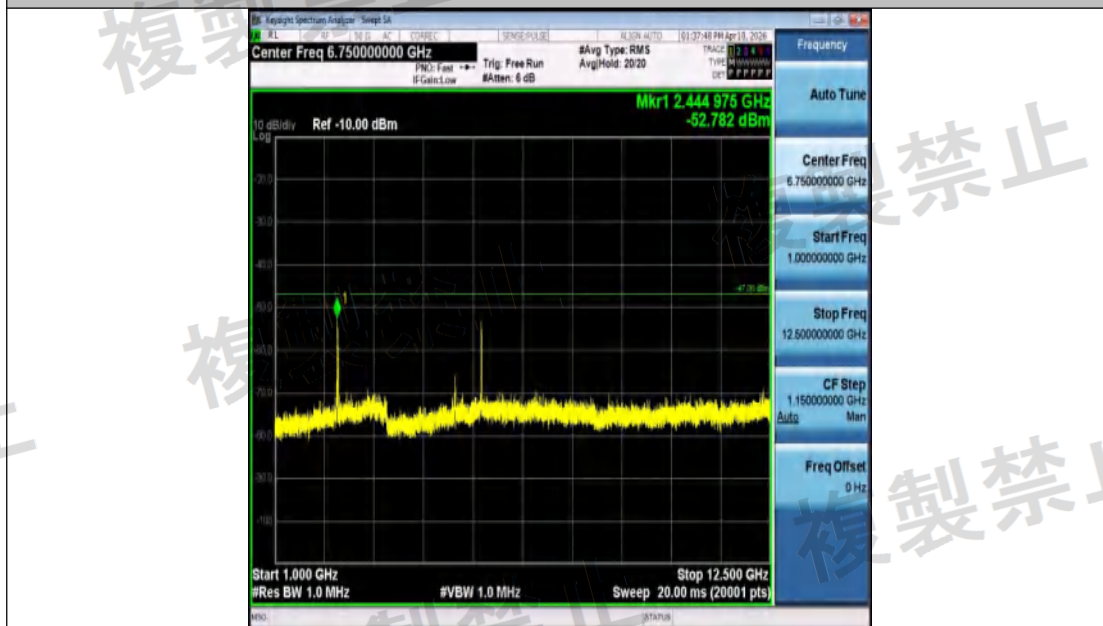


NTHV-3DH5-Ant1-2402-1000~12500-See table below



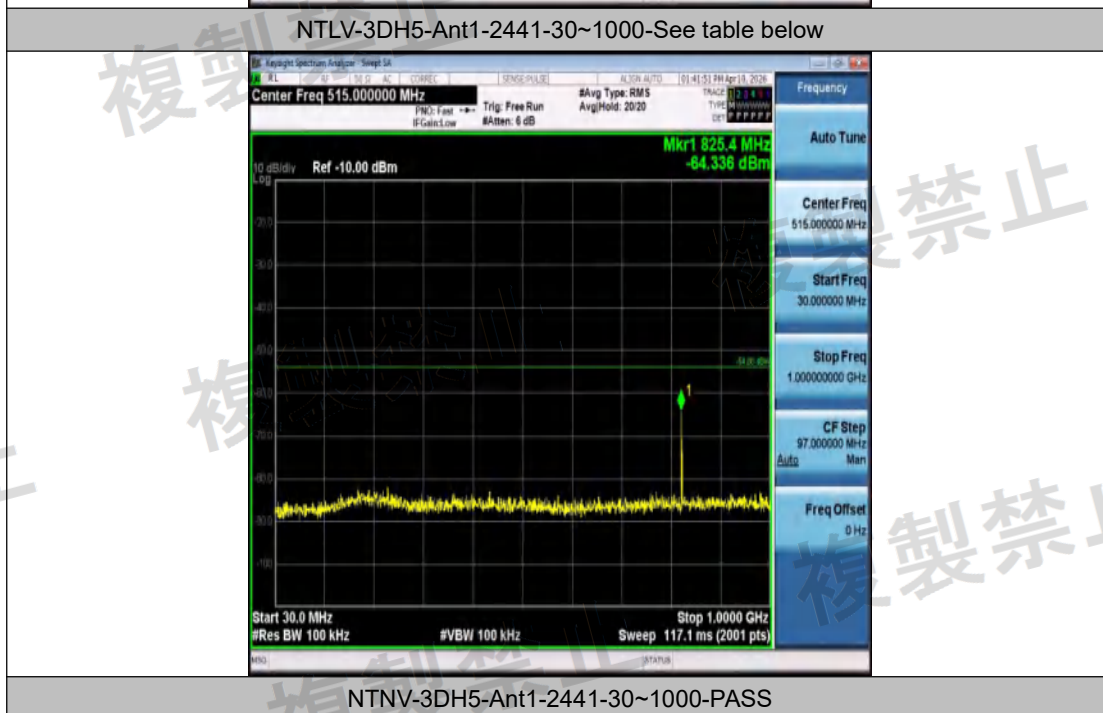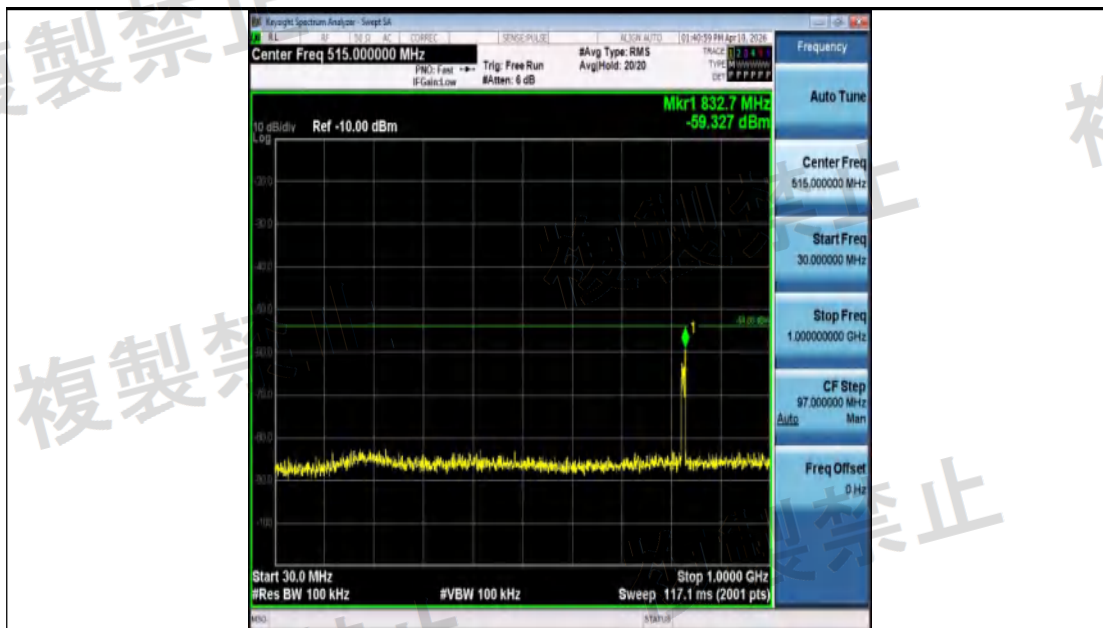


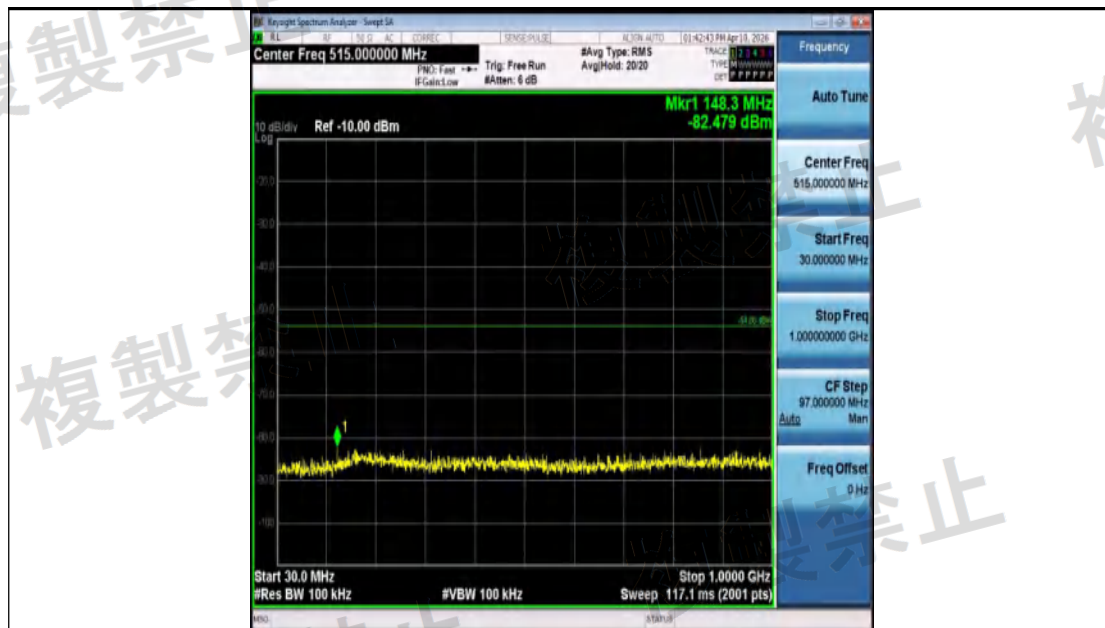



NTHV-3DH5-Ant1-2441-30~1000-PASS

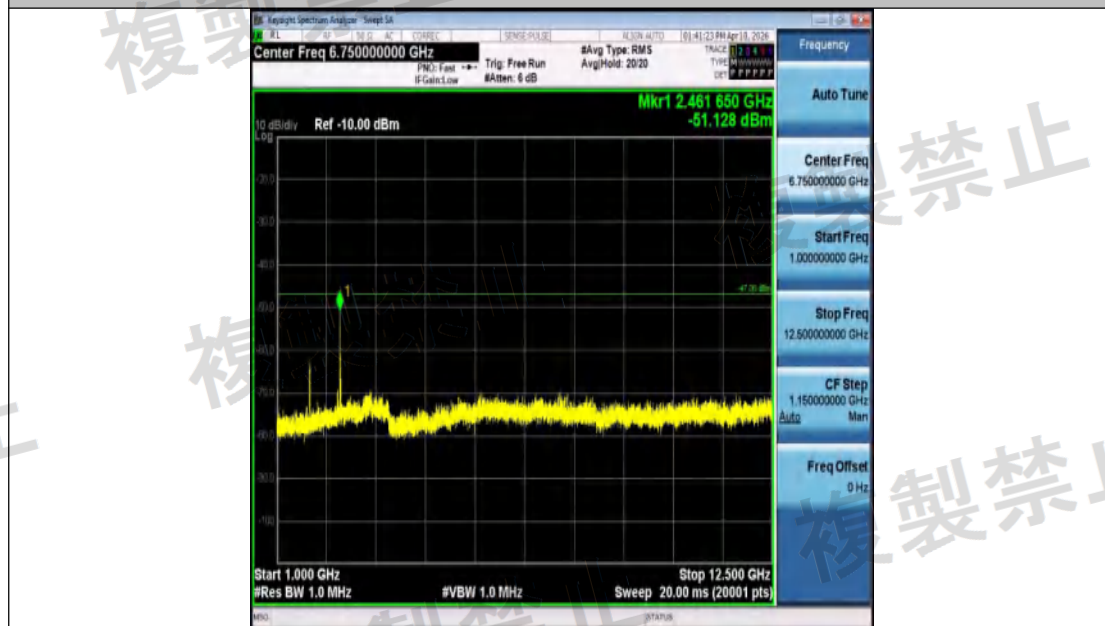


NTLV-3DH5-Ant1-2441-1000~12500-See table below



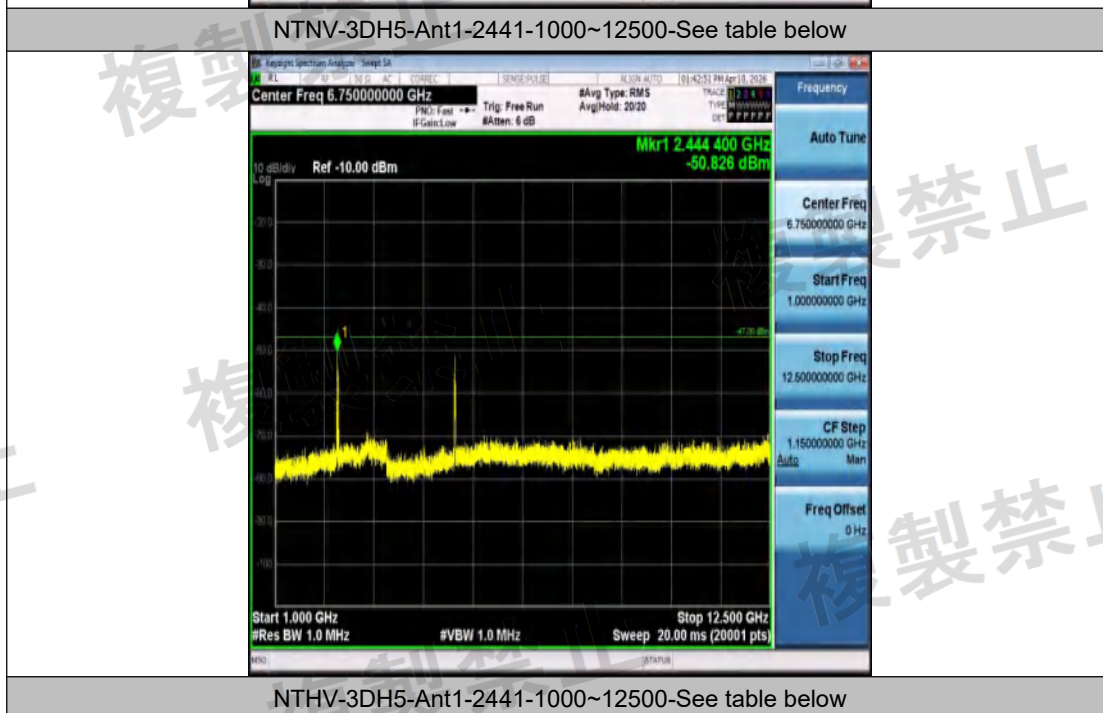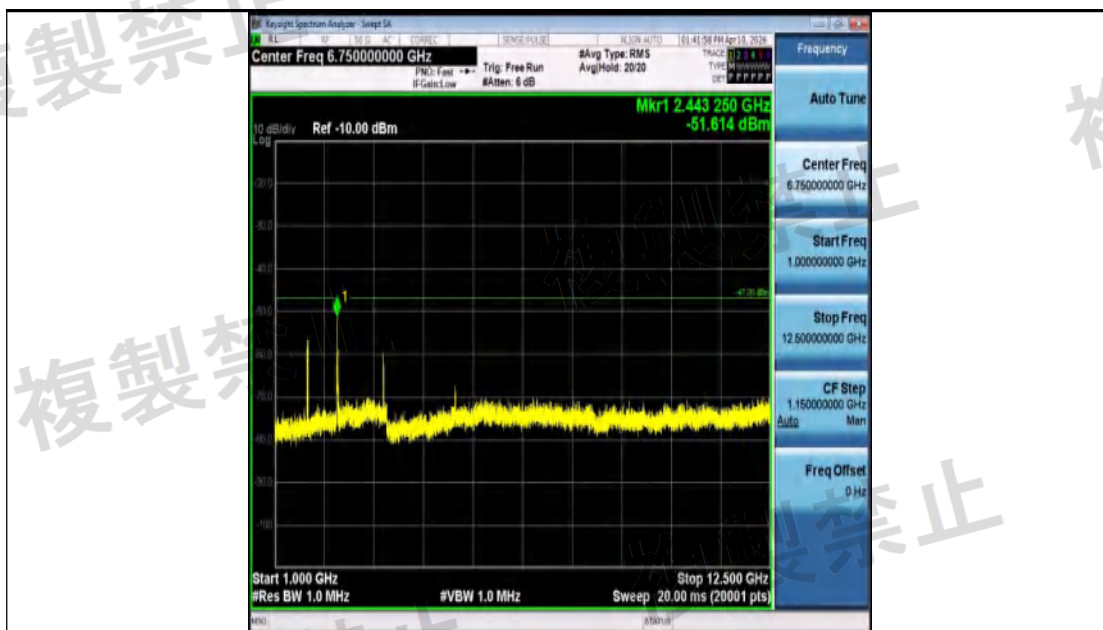

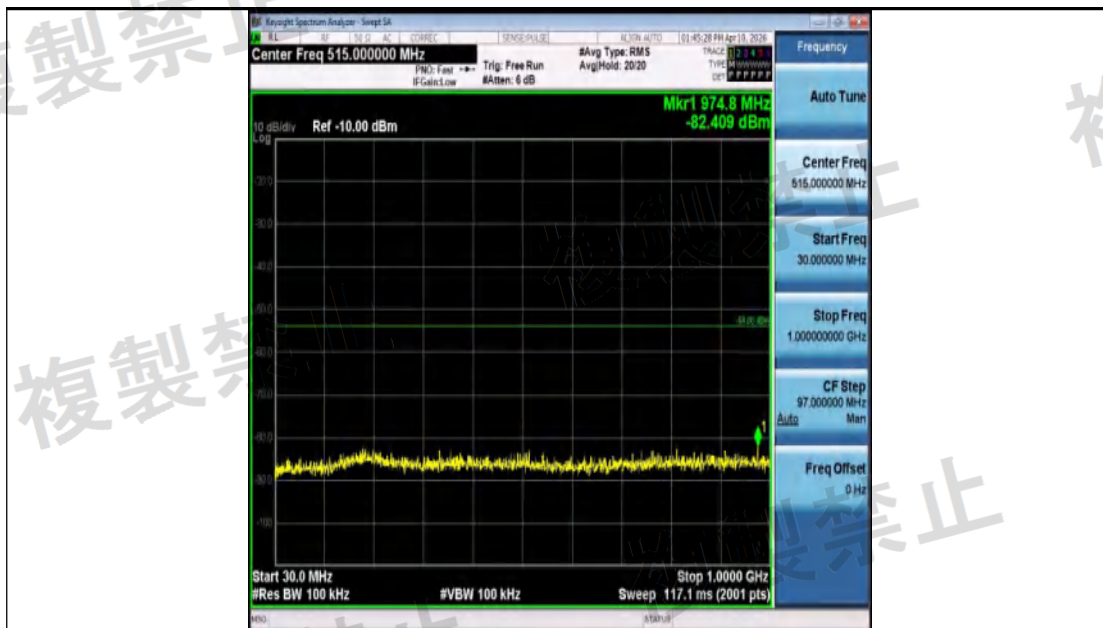


NTLV-3DH5-Ant1-2480-30~1000-PASS

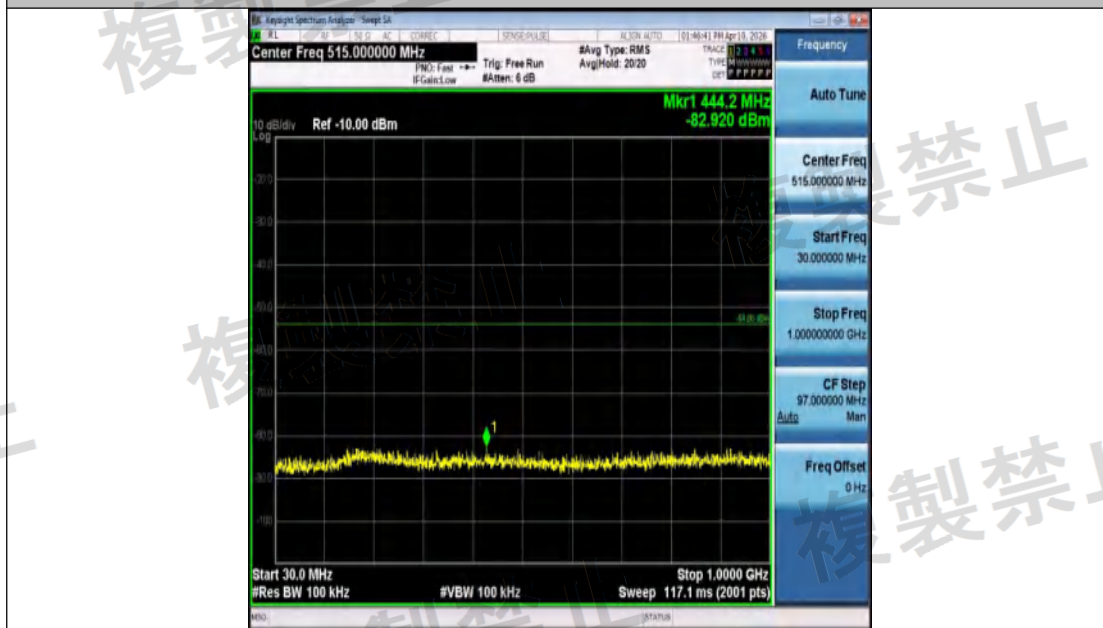


NTNV-3DH5-Ant1-2480-30~1000-PASS



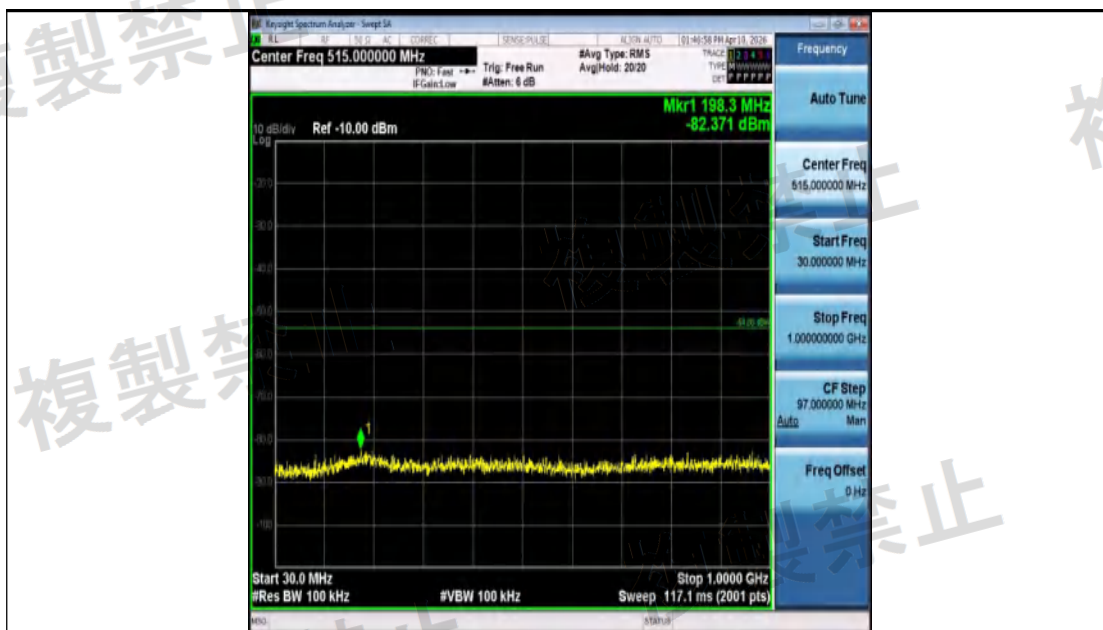


NTHV-3DH5-Ant1-2480-30~1000-PASS

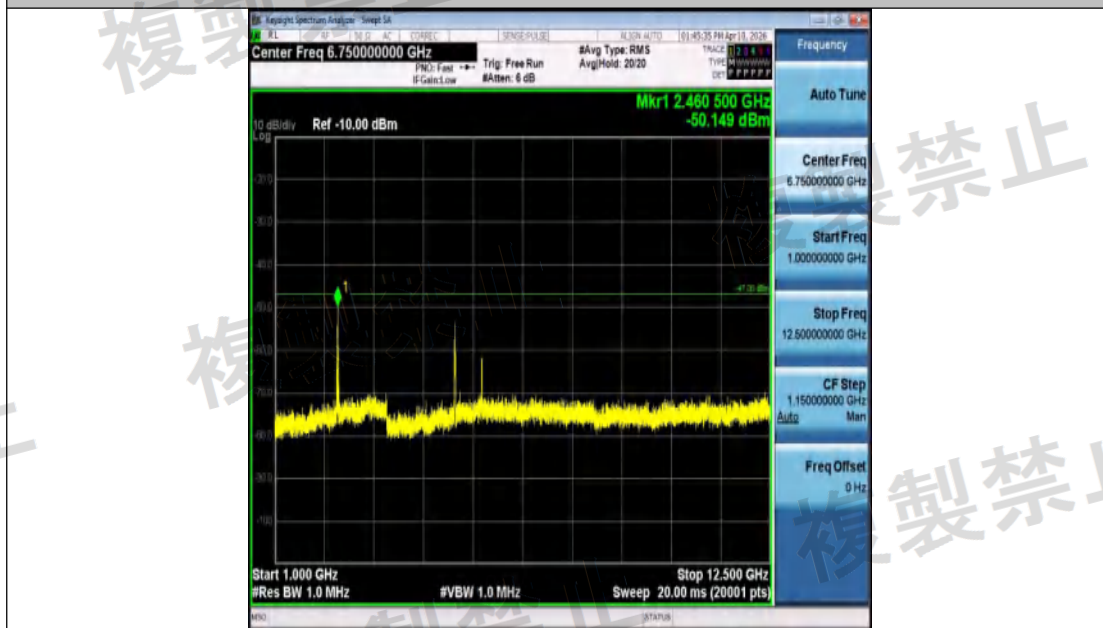


NTLV-3DH5-Ant1-2480-1000~12500-See table below



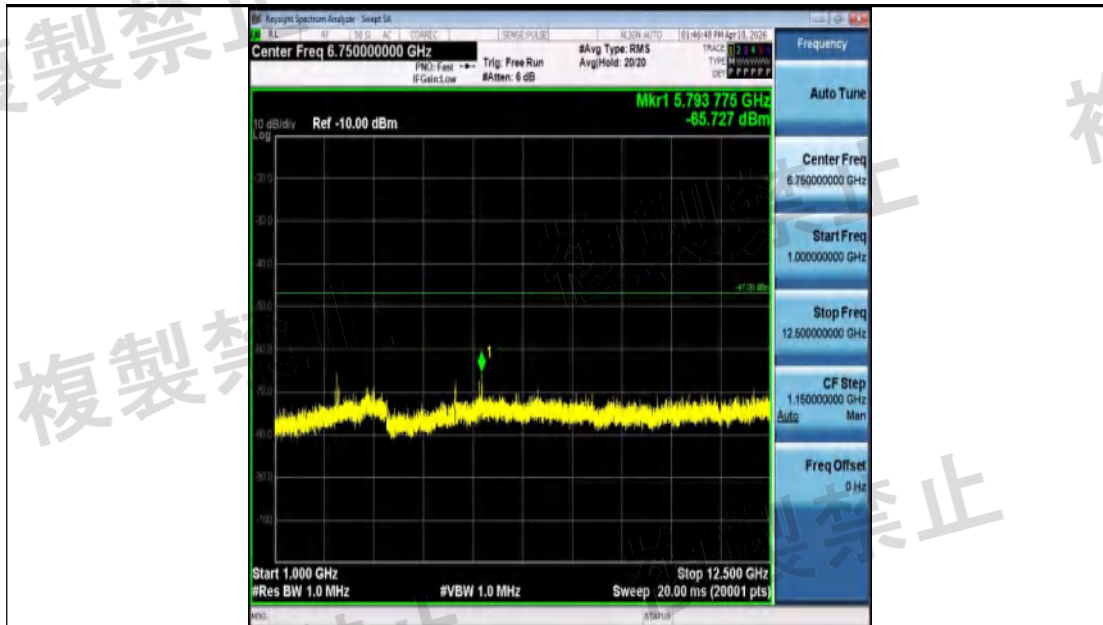


NTHV-3DH5-Ant1-2480-1000~12500-PASS

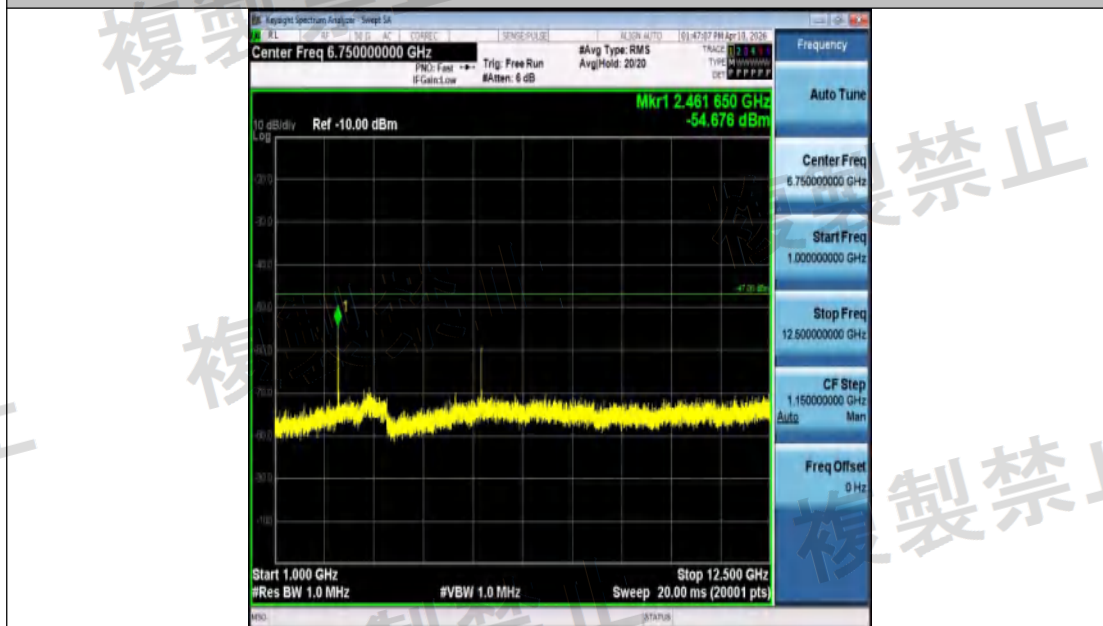

NTHV-3DH5-Ant1-2480-1000~12500-See table below



Test Graphs_Step2

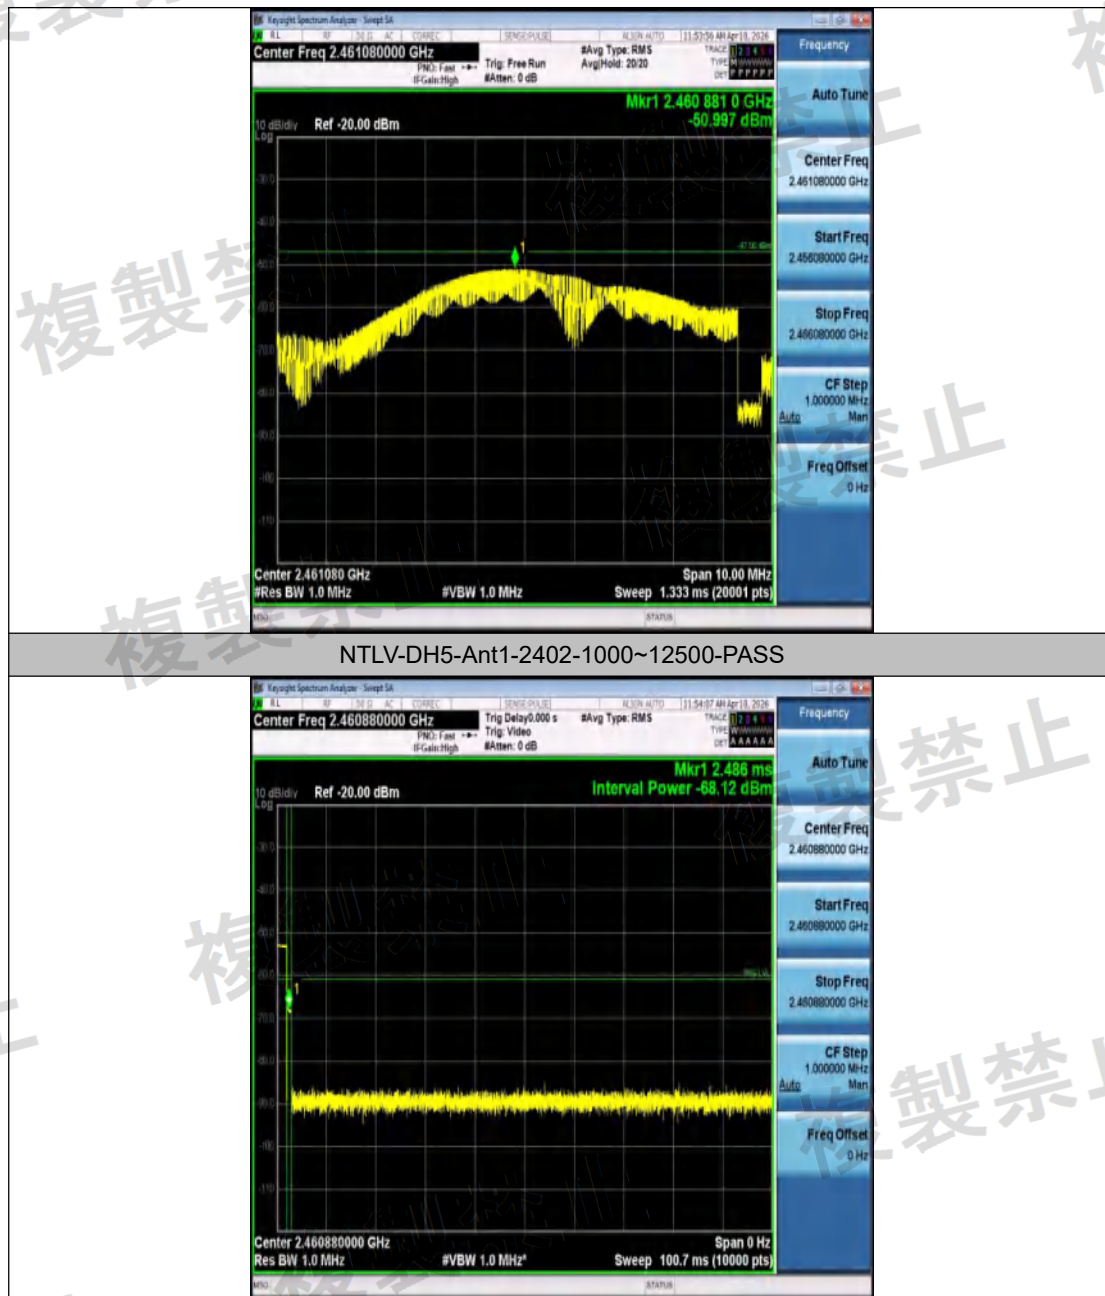

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China

Tel: (86) 0755-26066440 Email: service@anbotek.com





Hotline


400-003-0500


www.anbotek.com




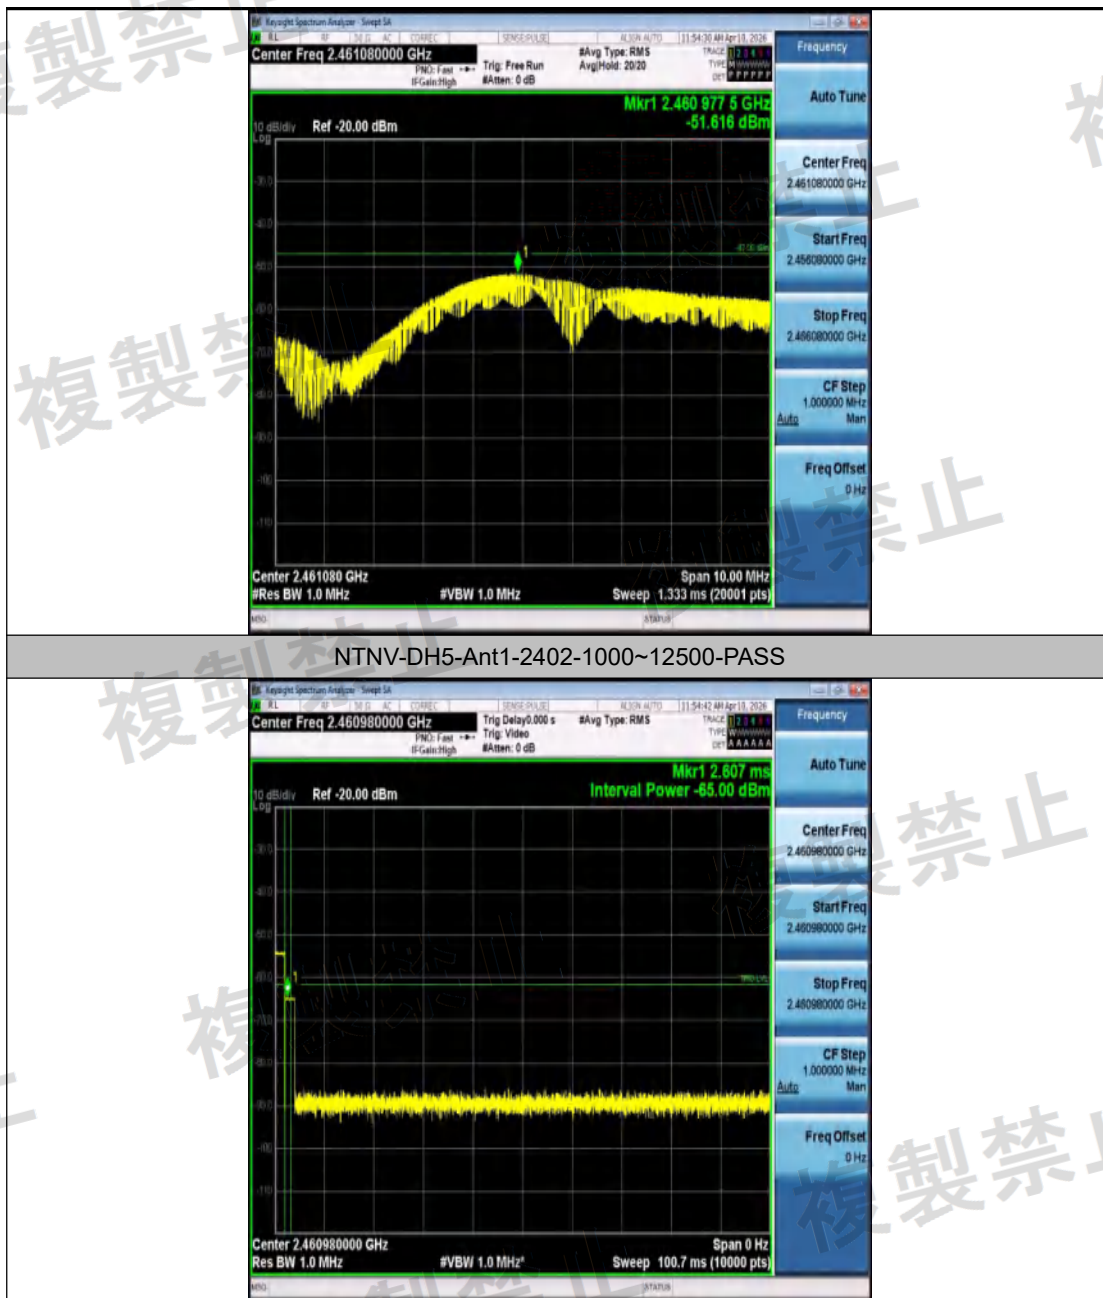


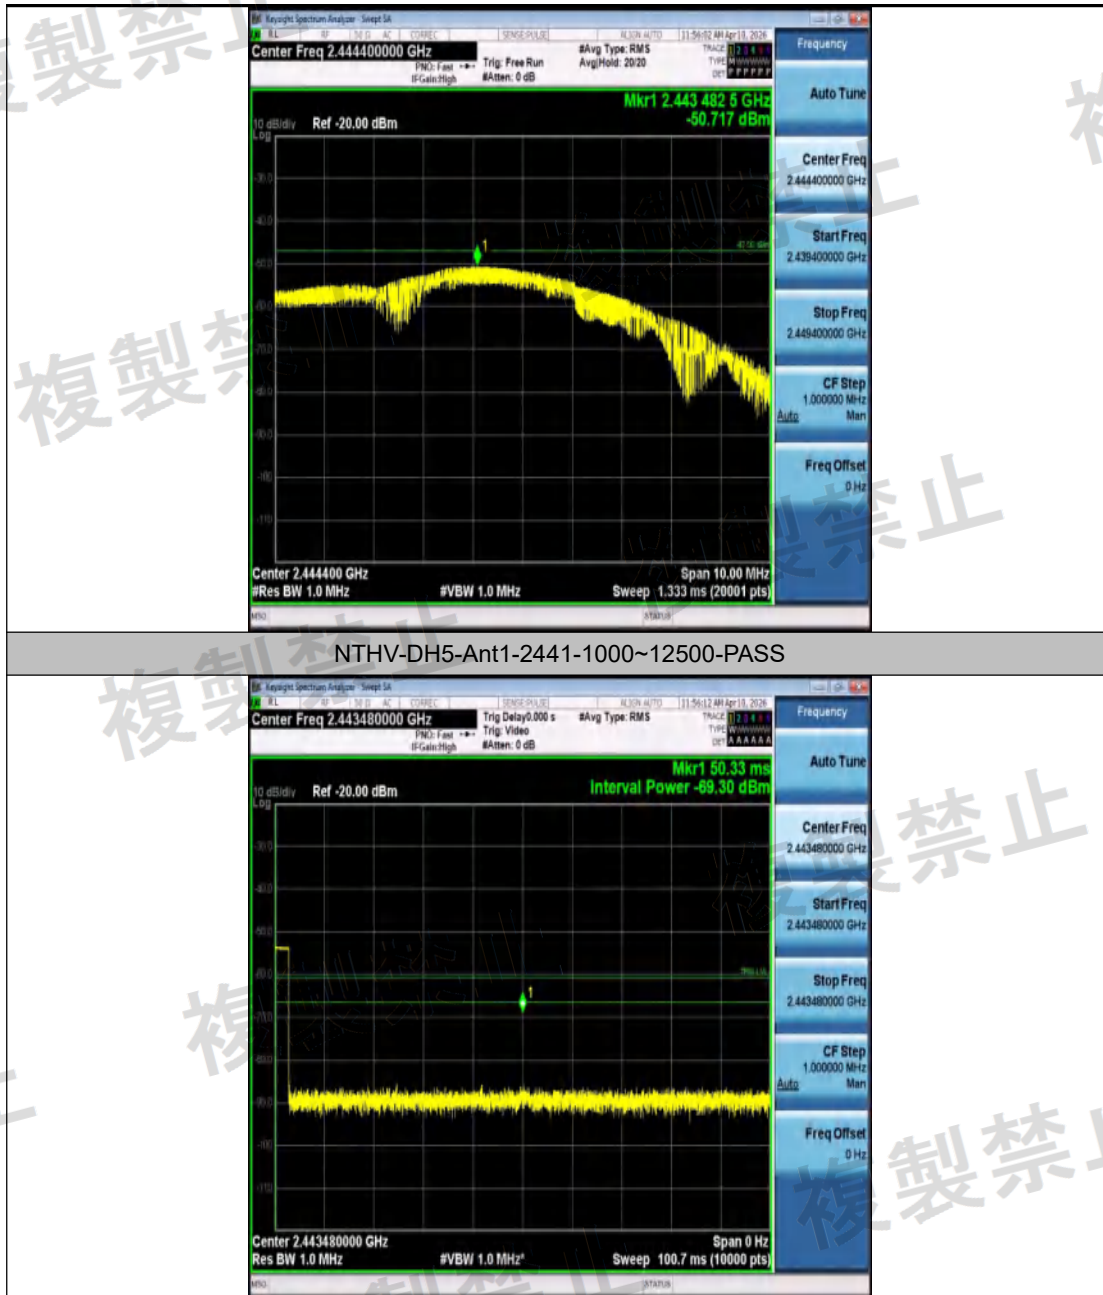


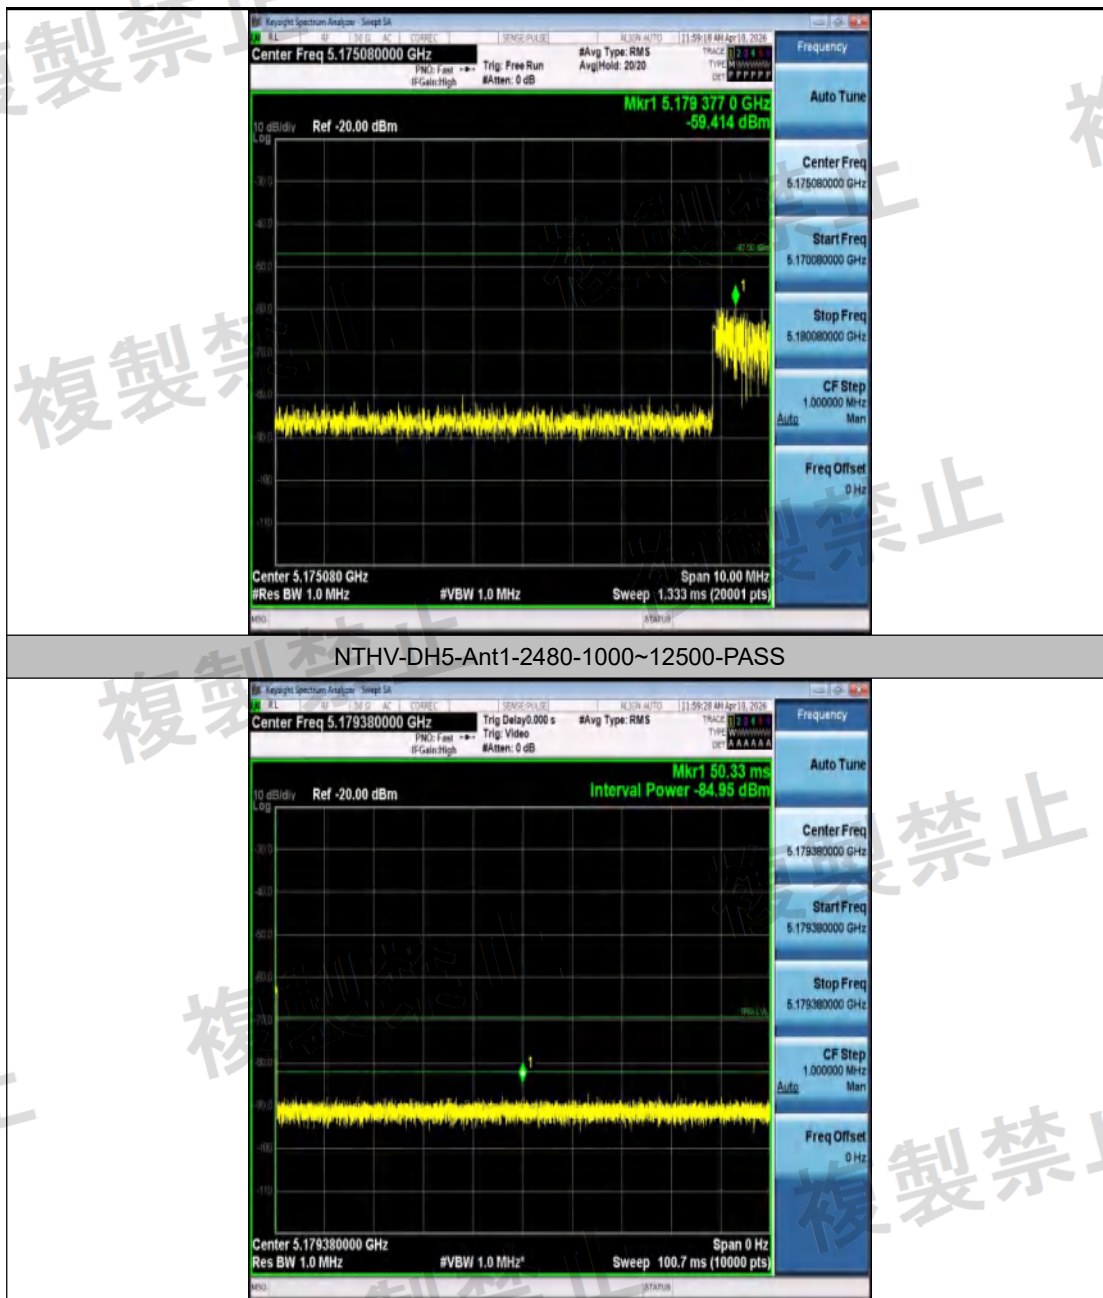


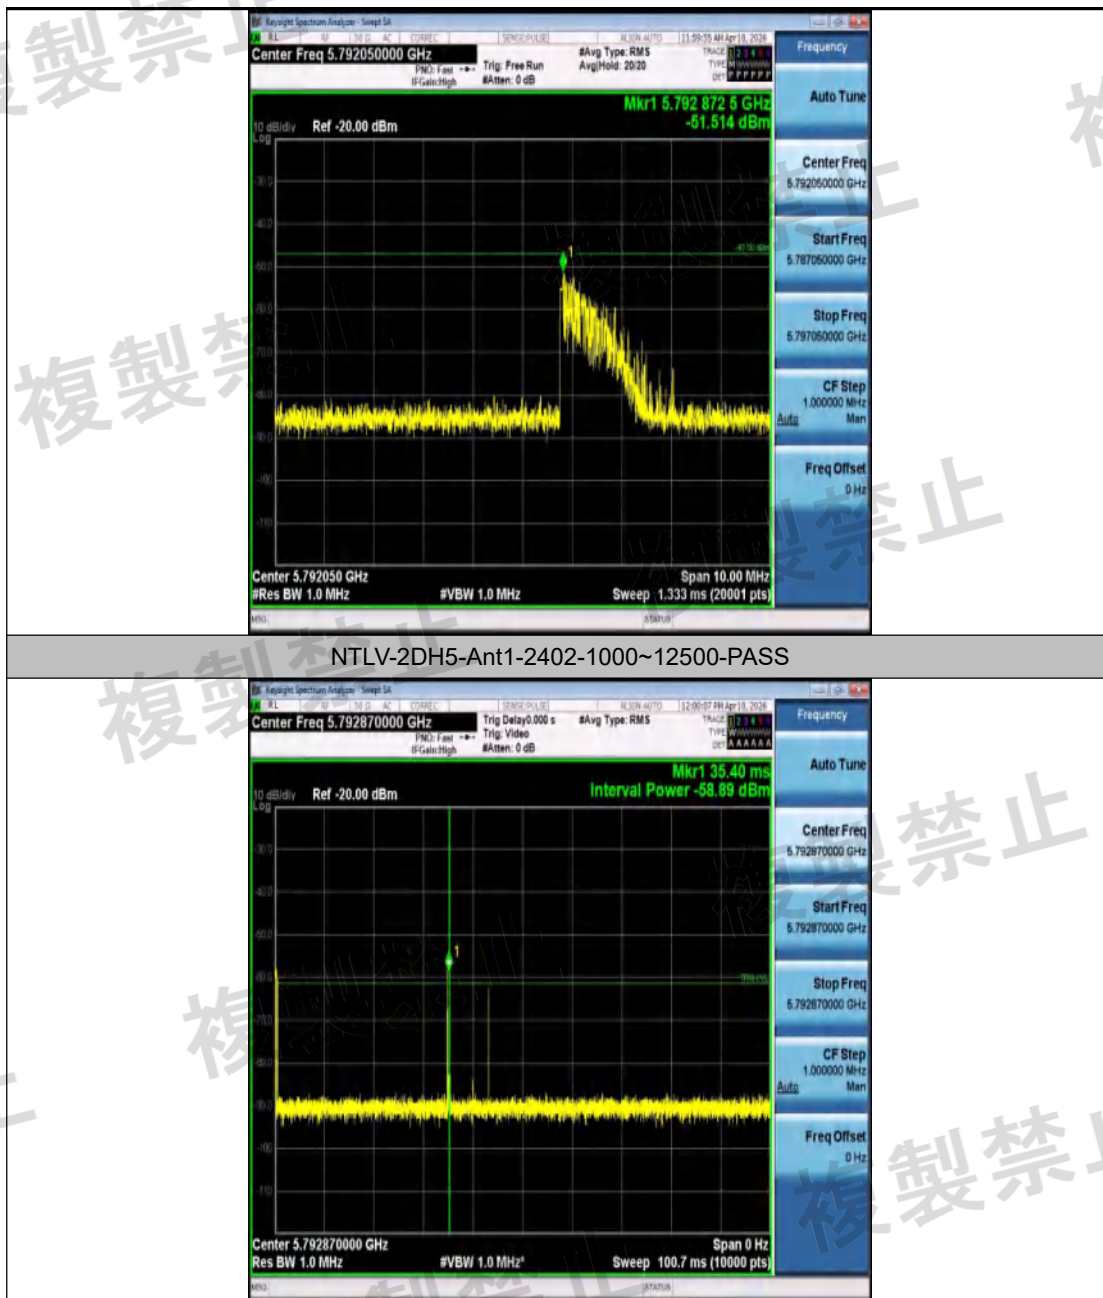


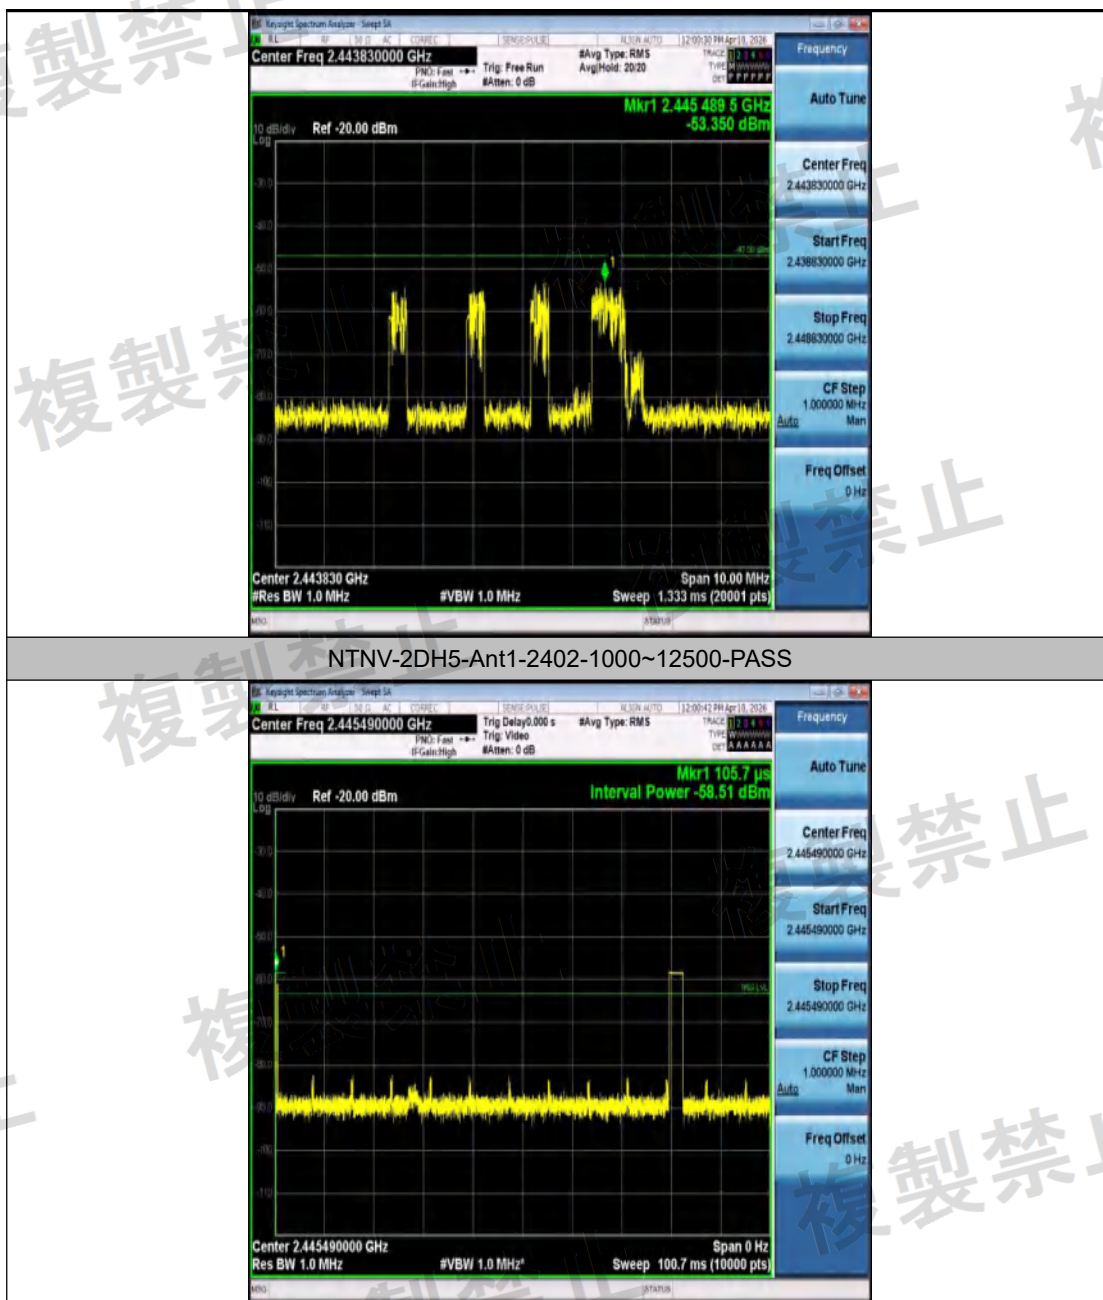


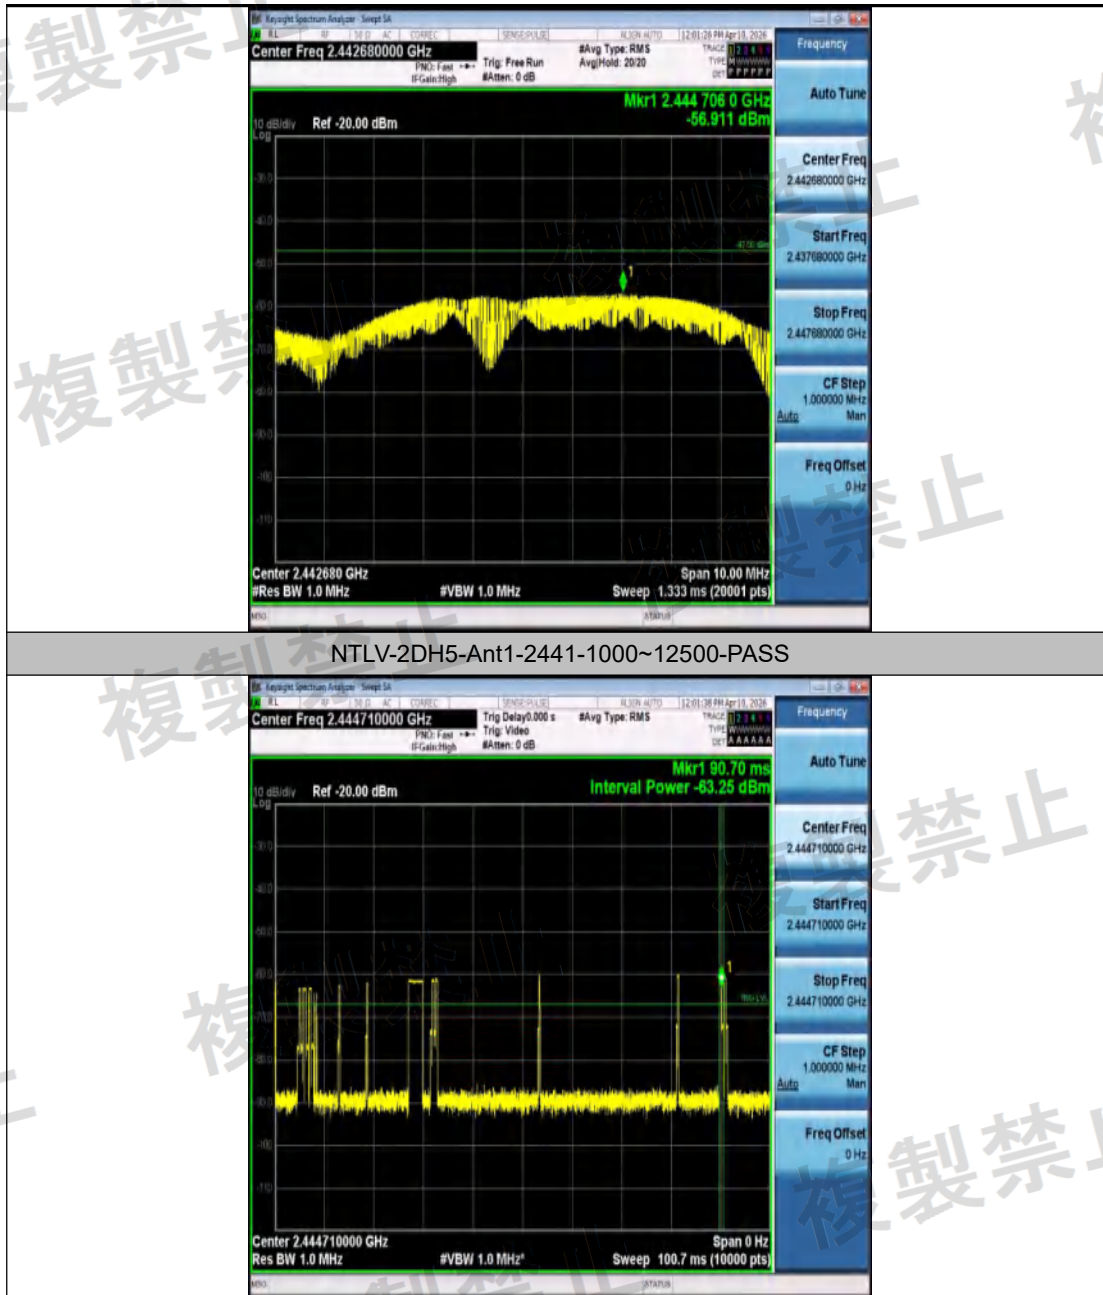


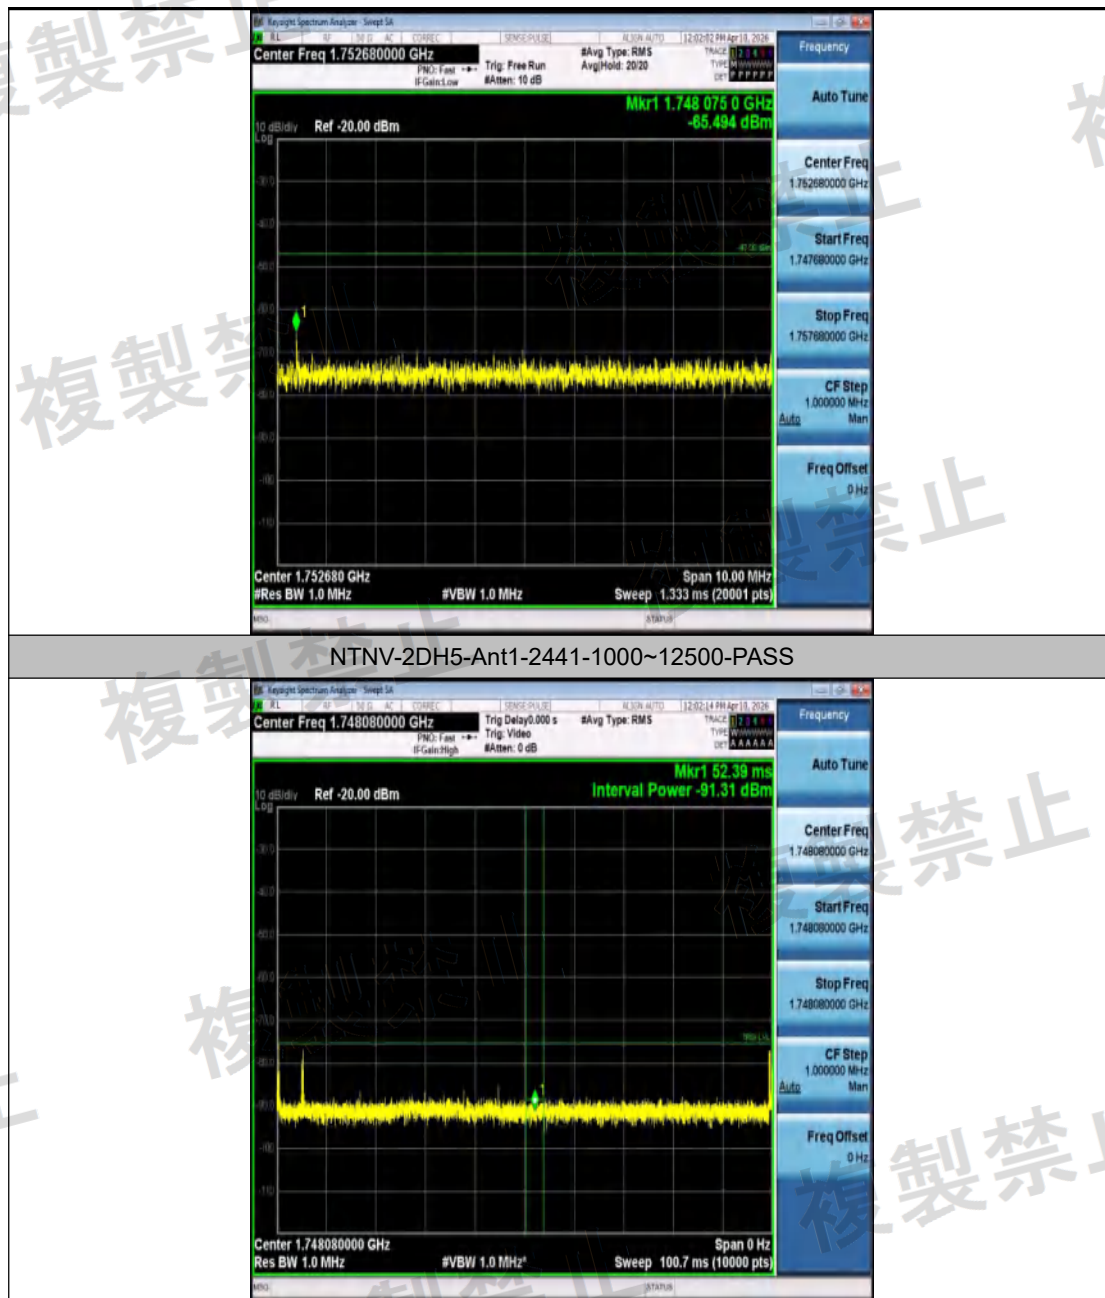


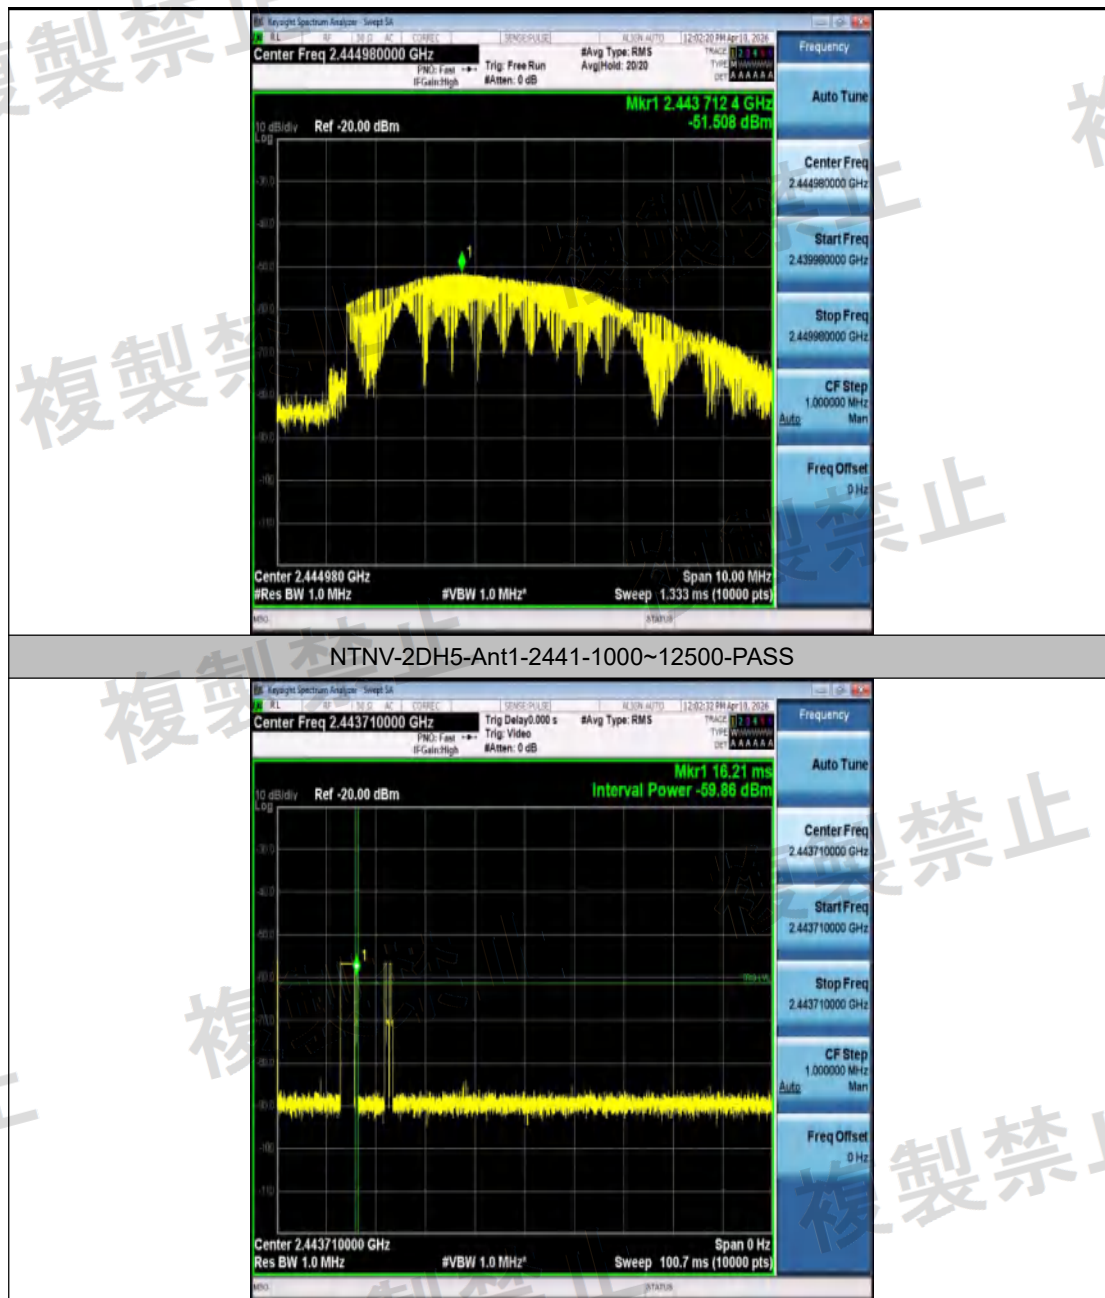


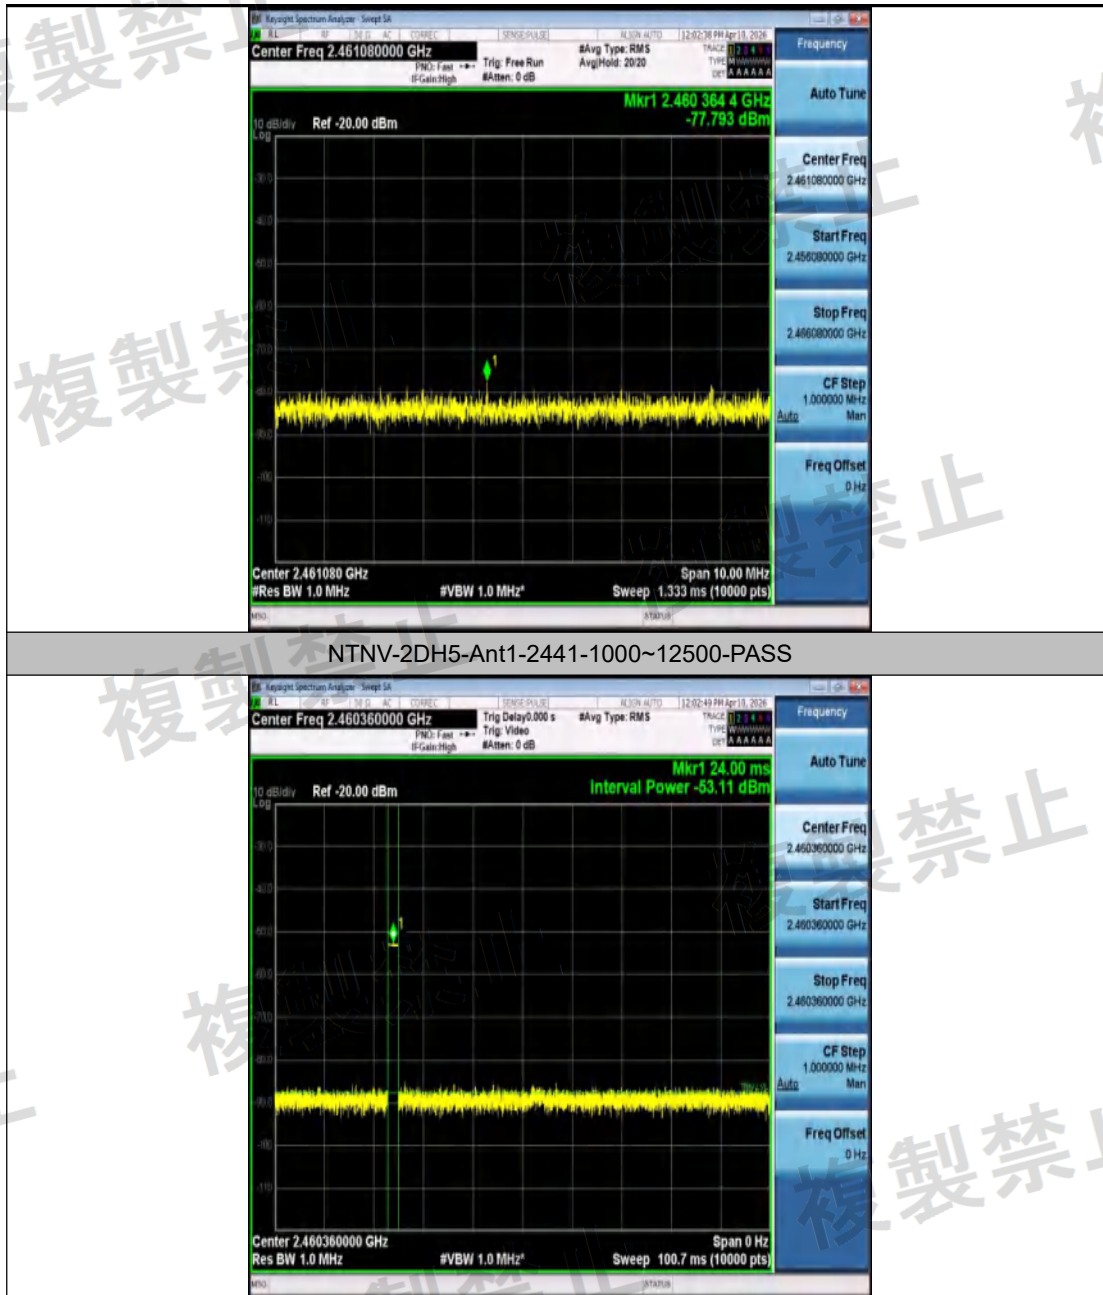


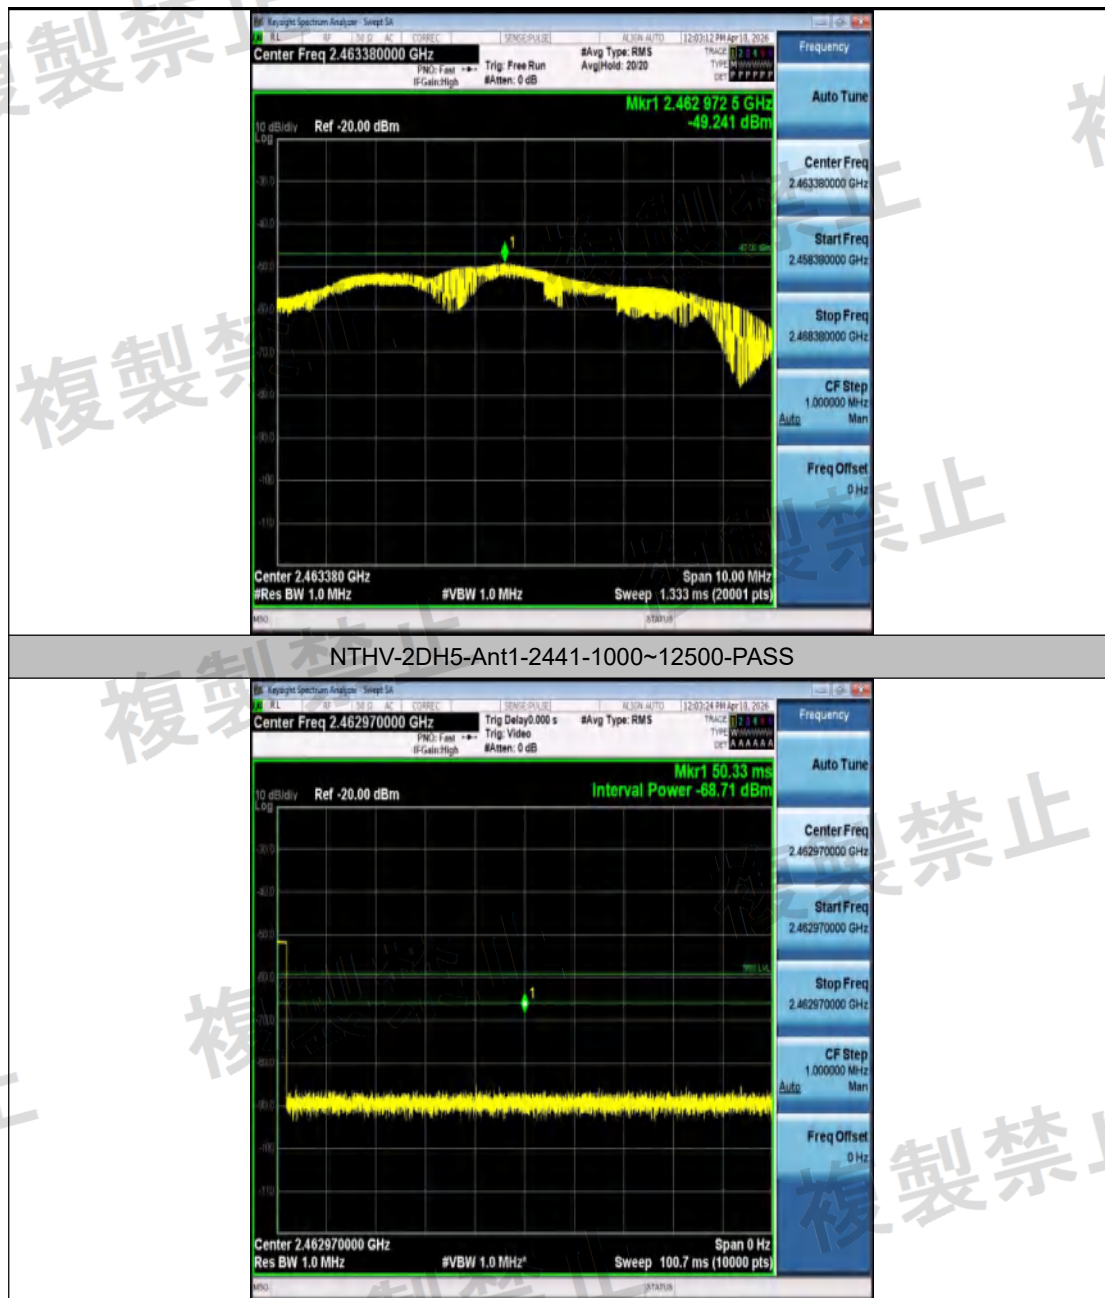


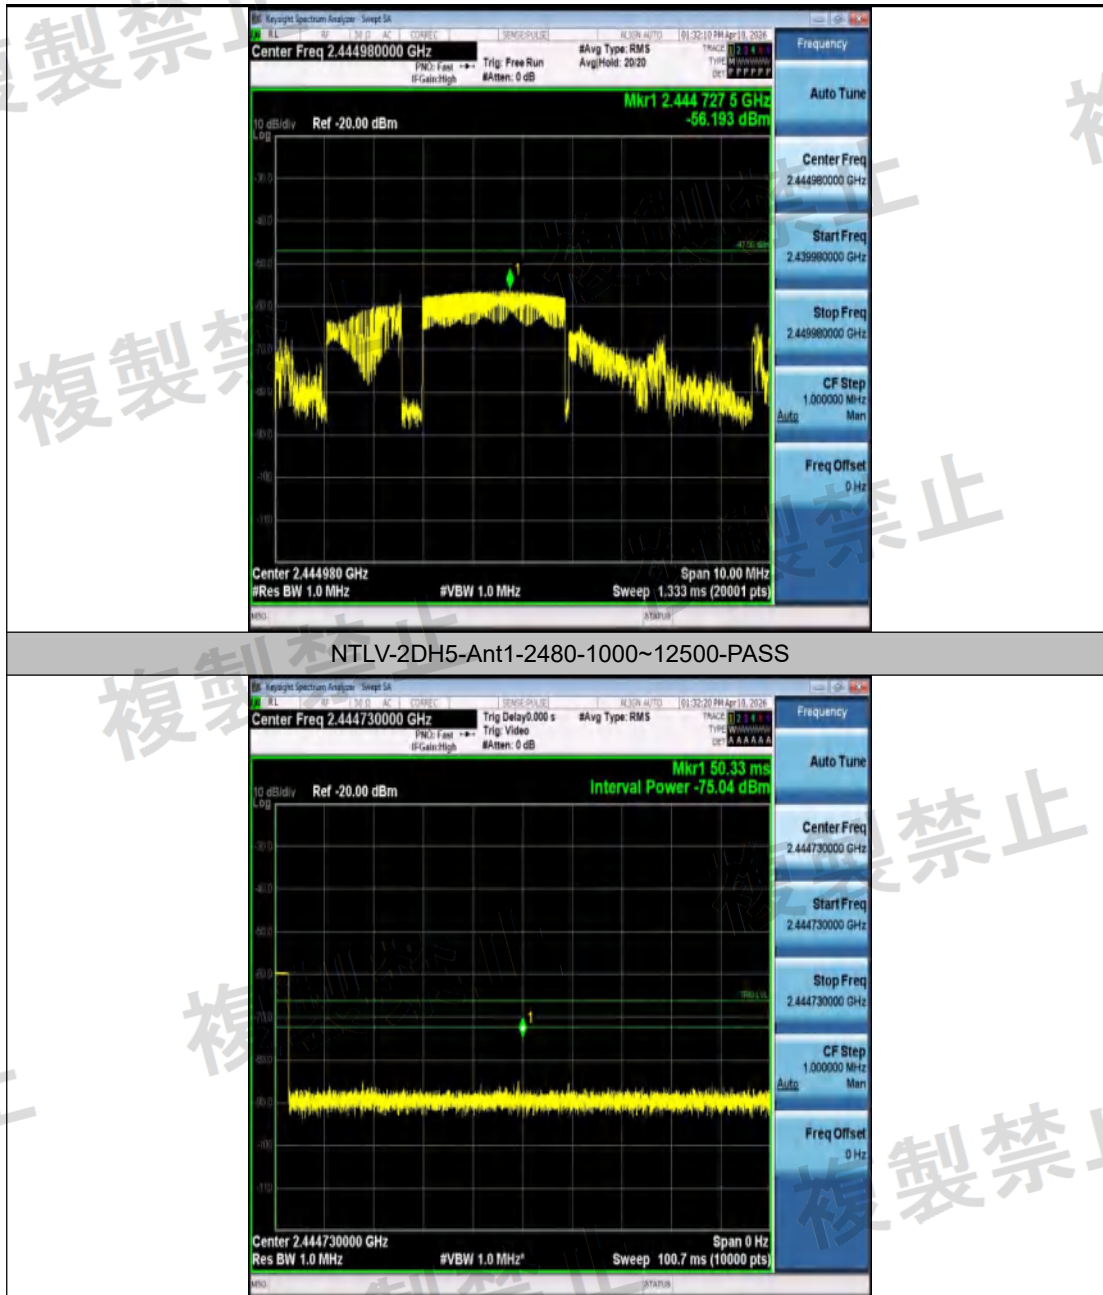


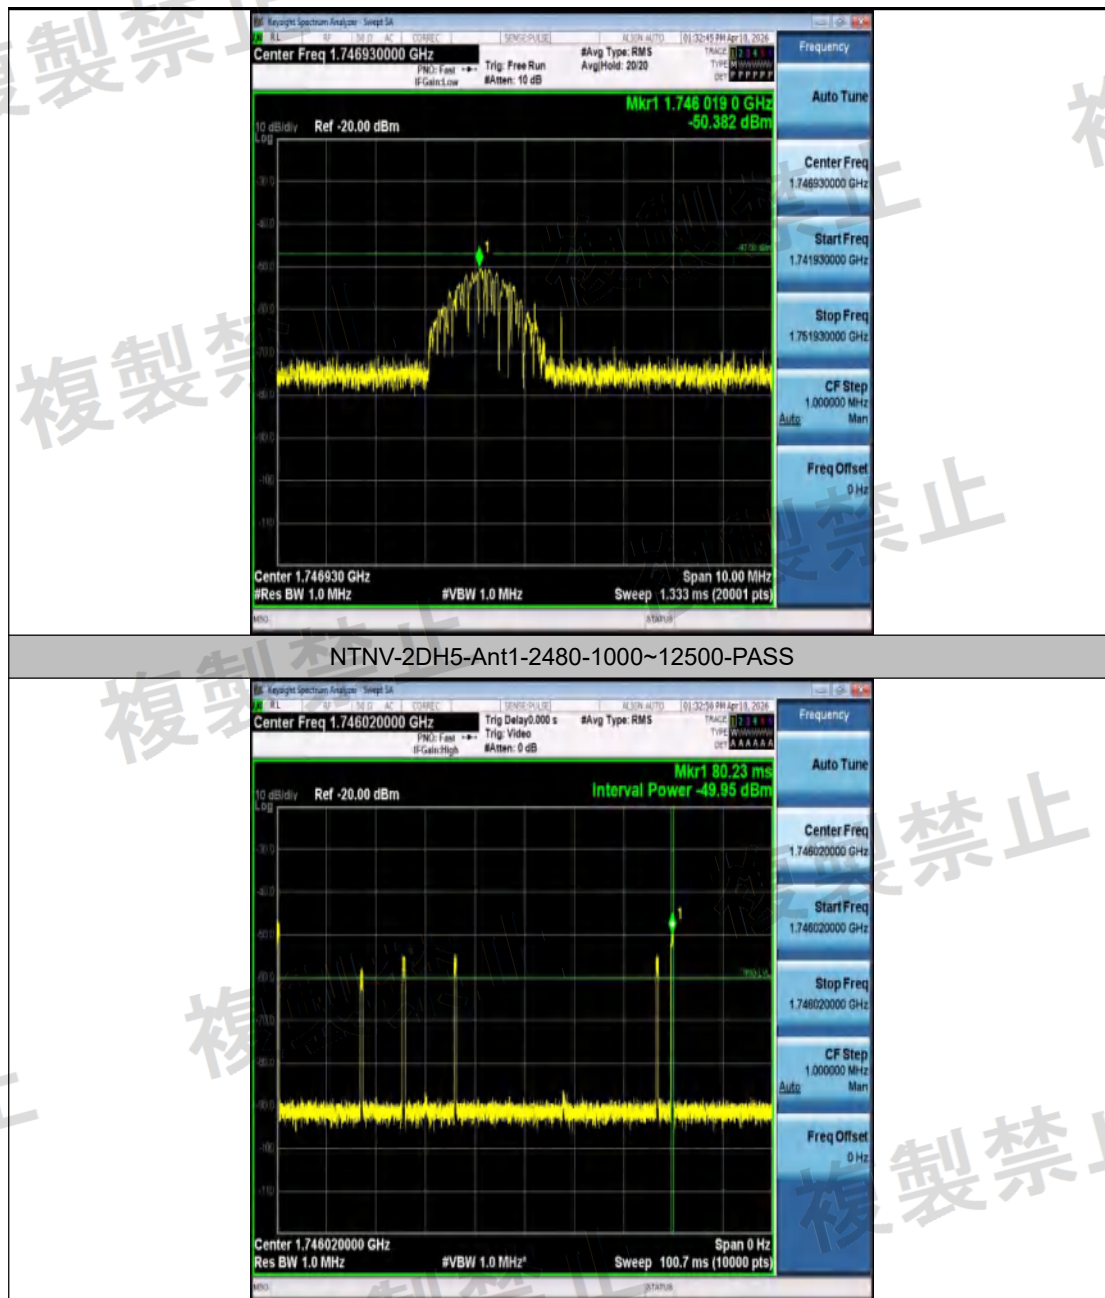


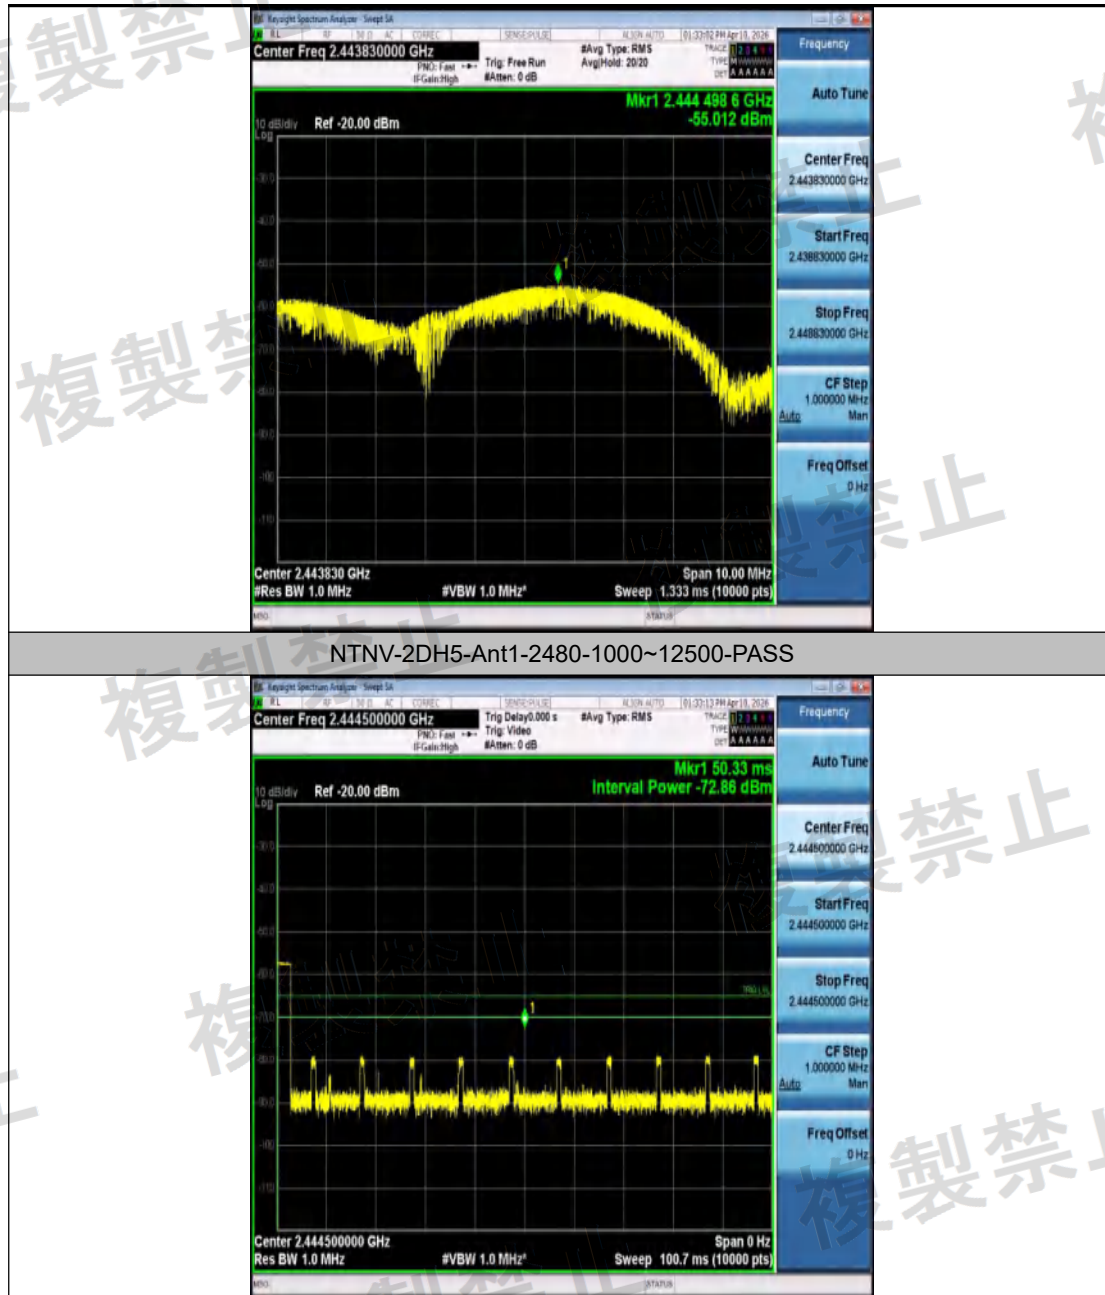


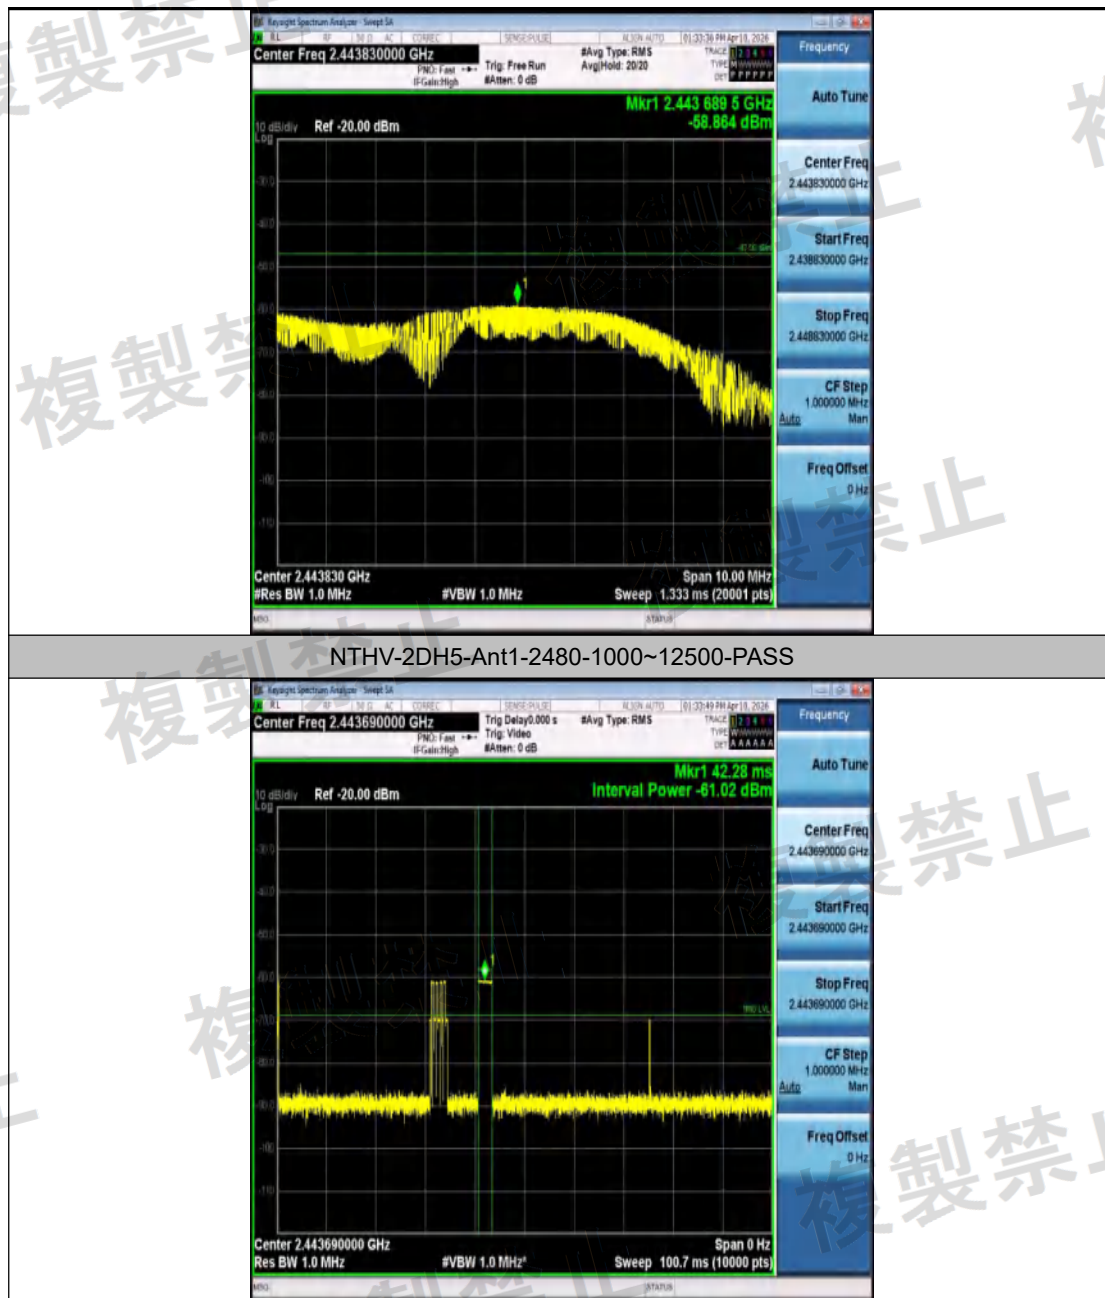


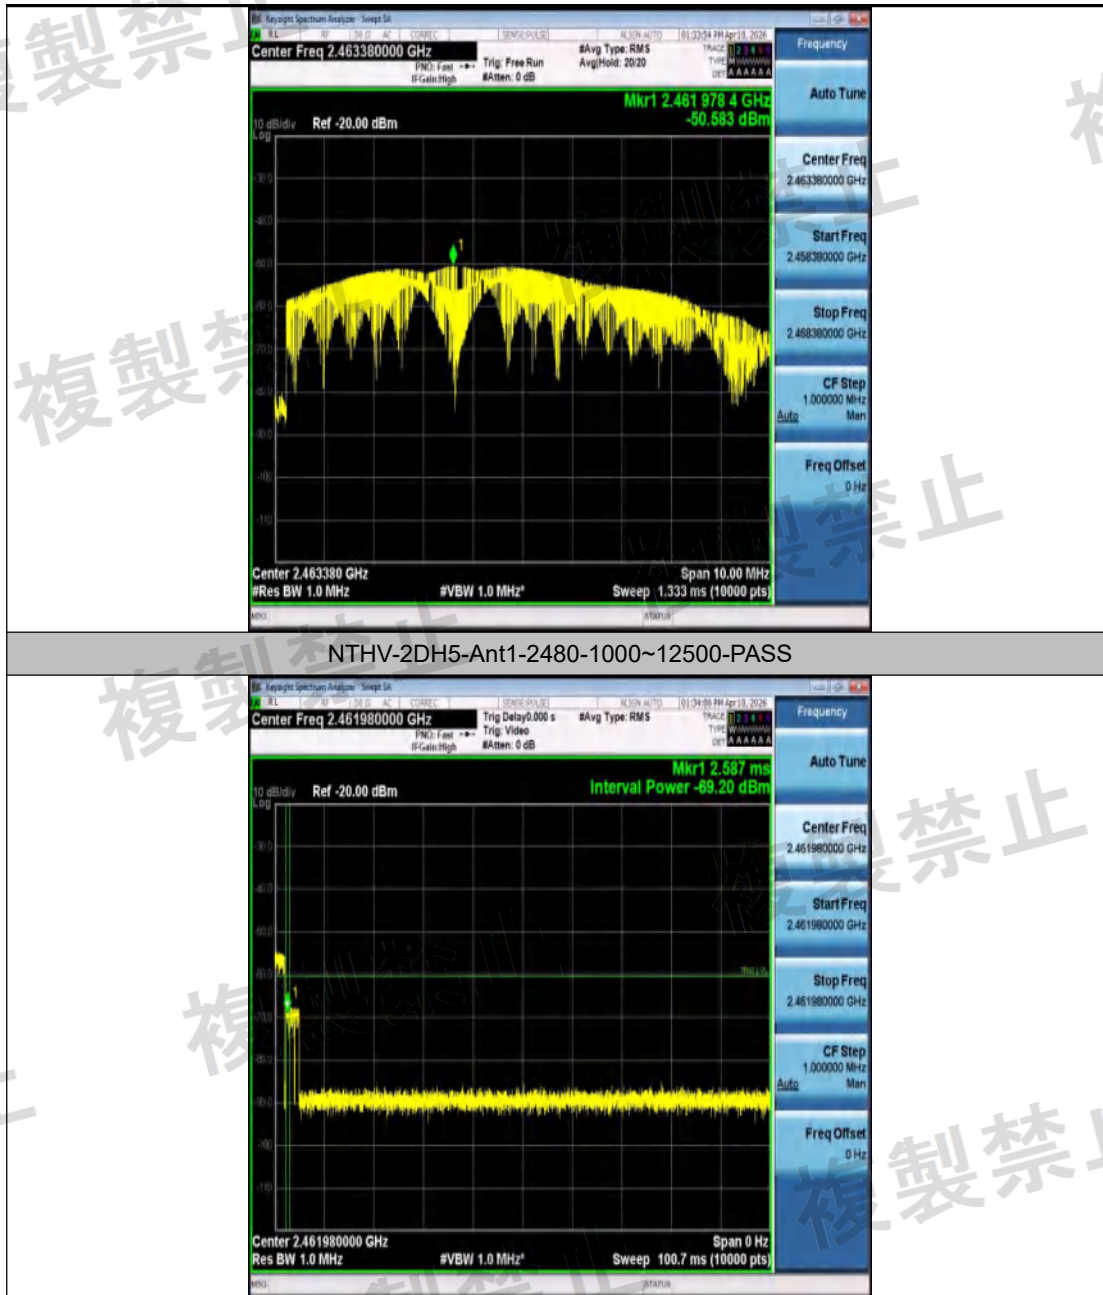


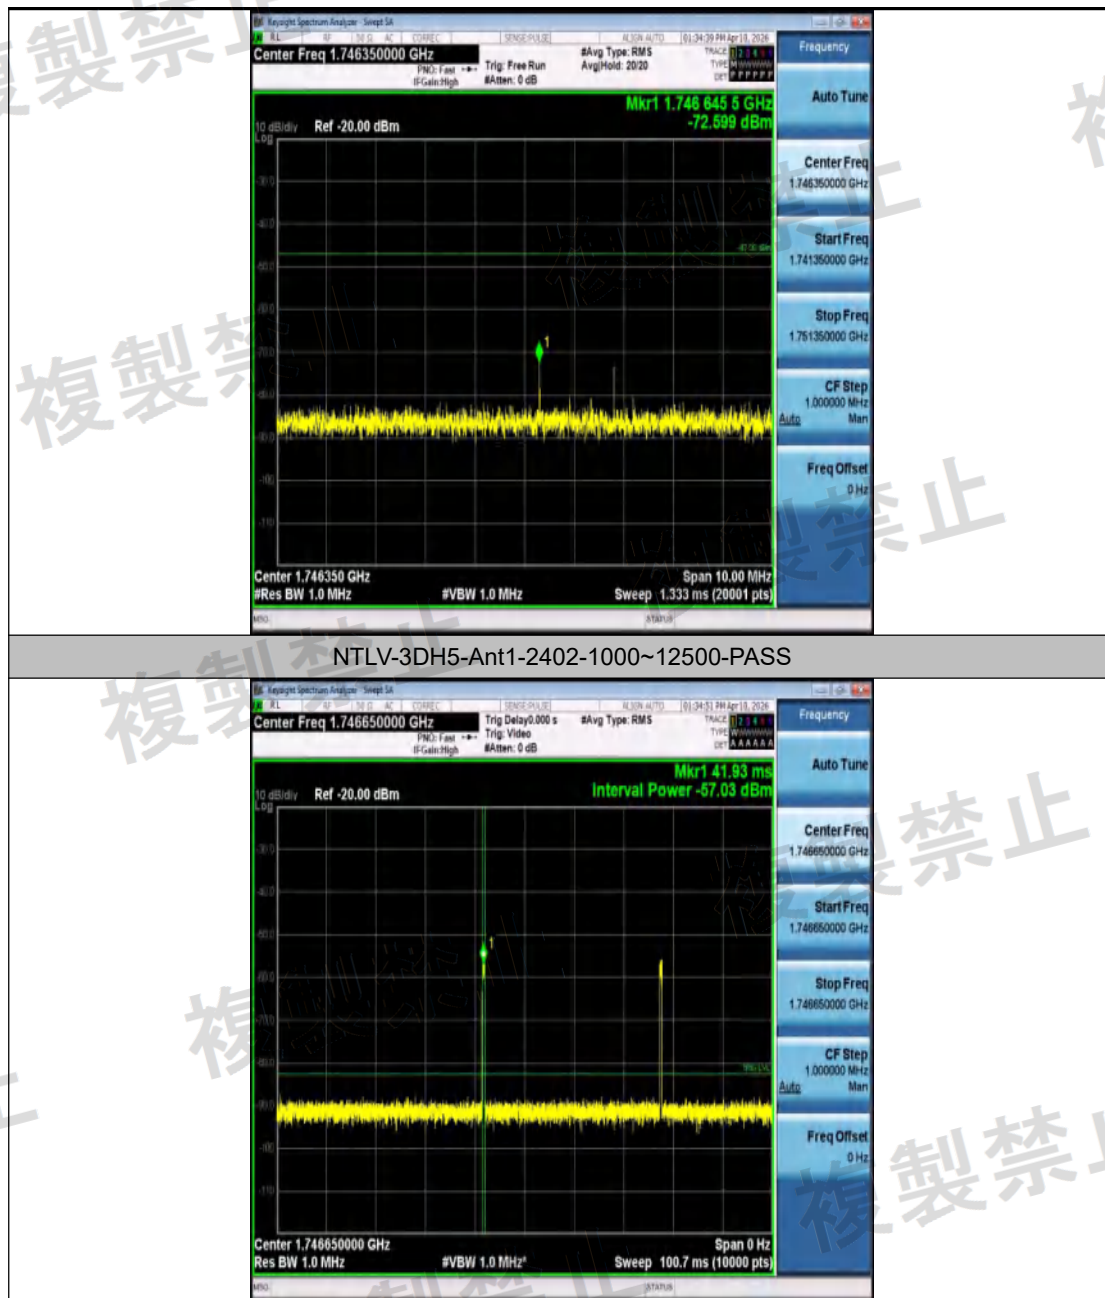


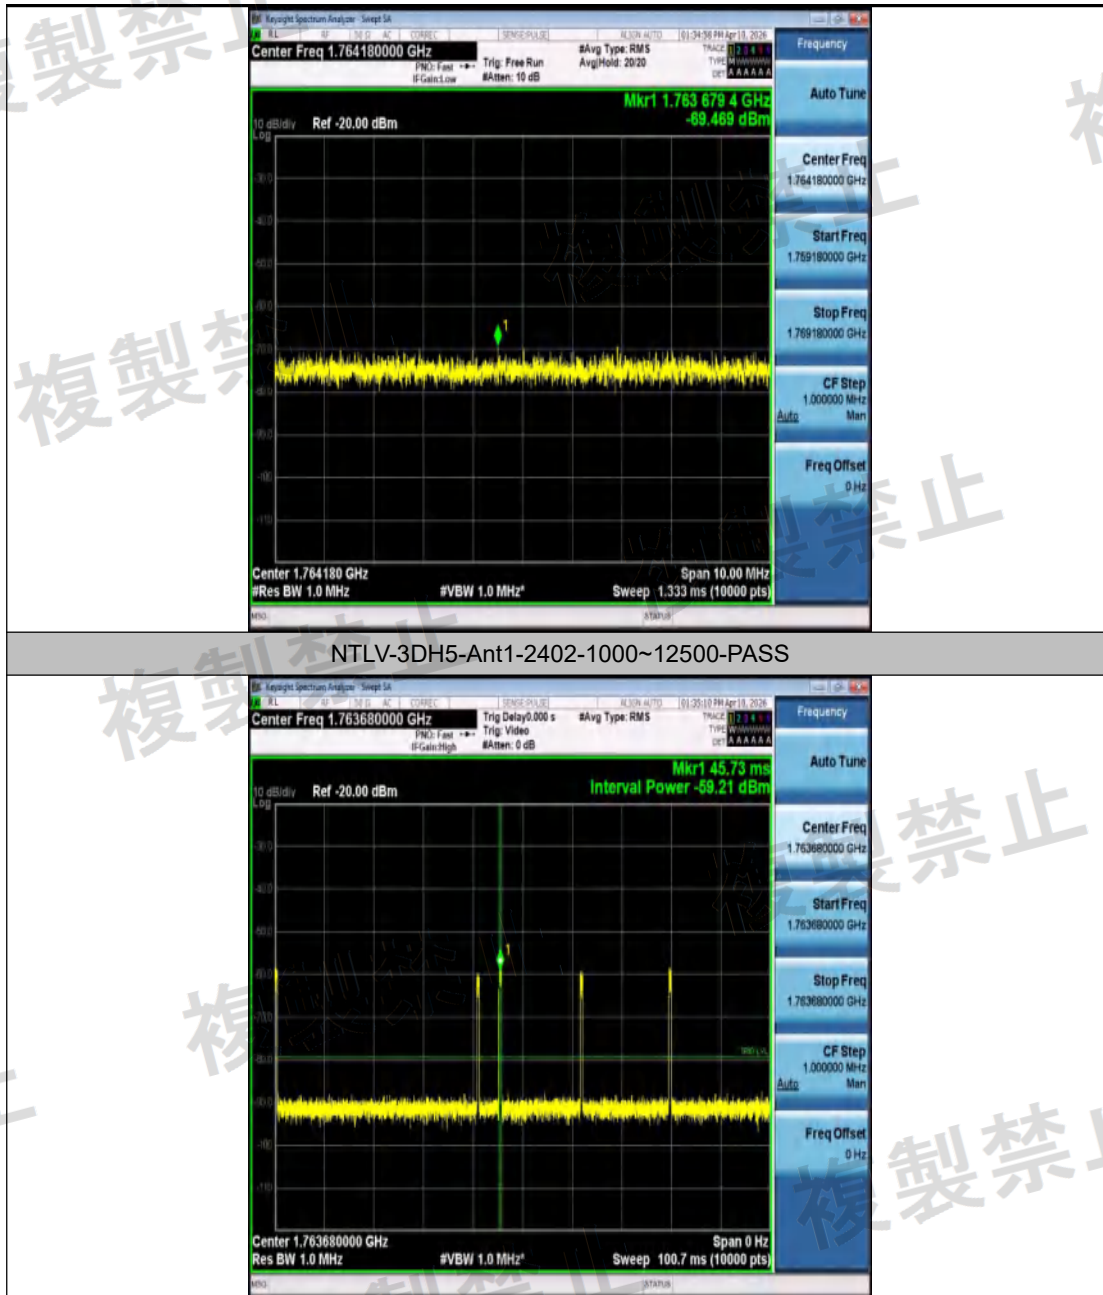


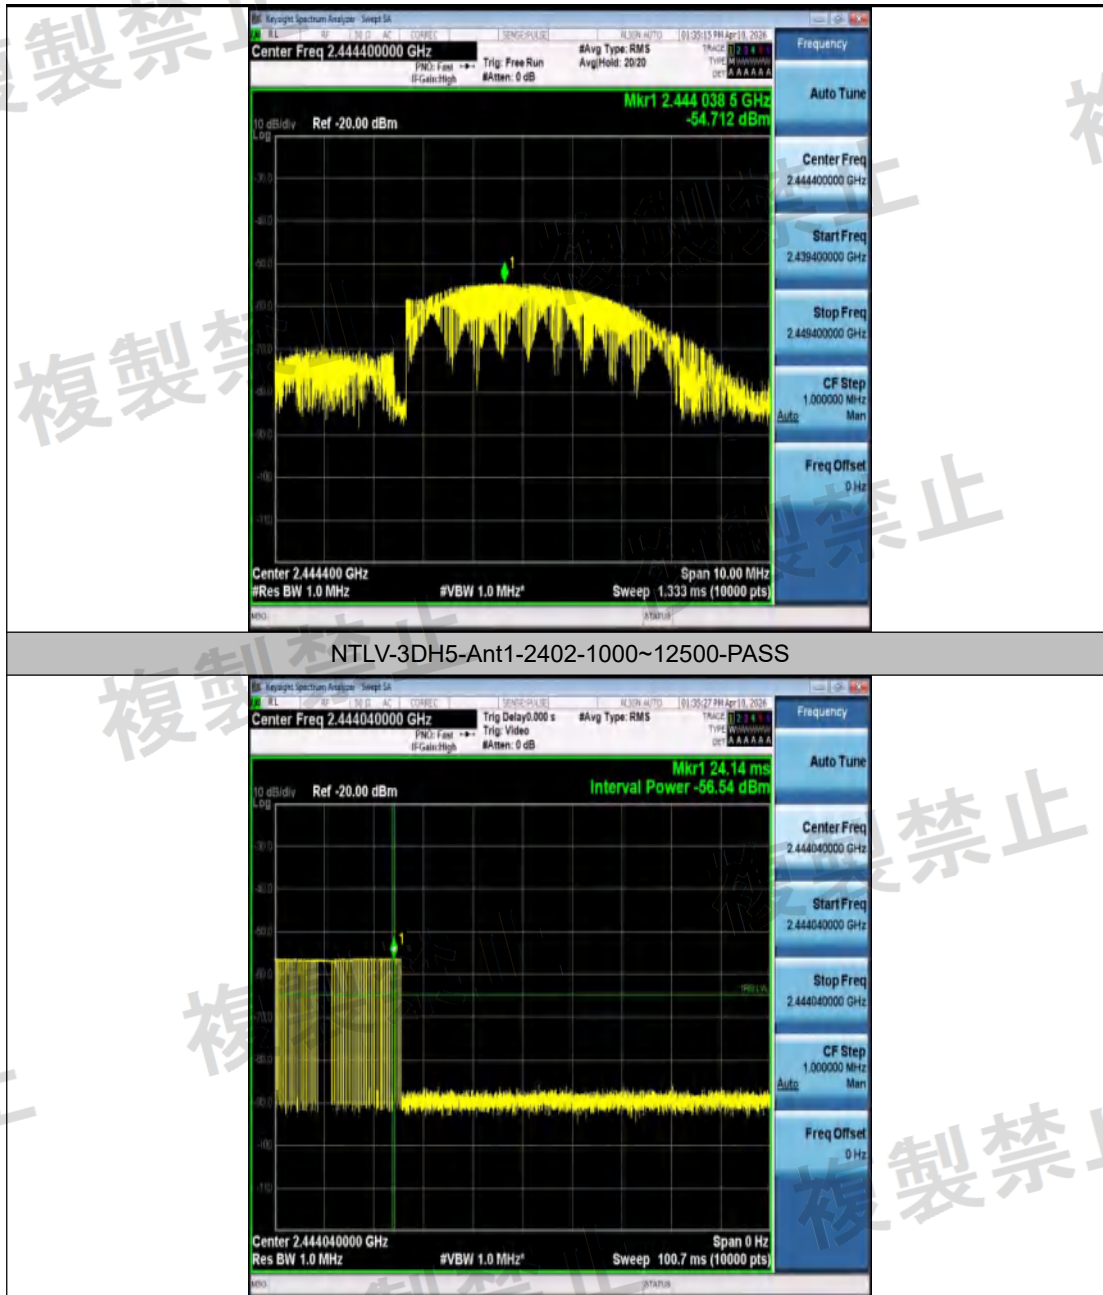


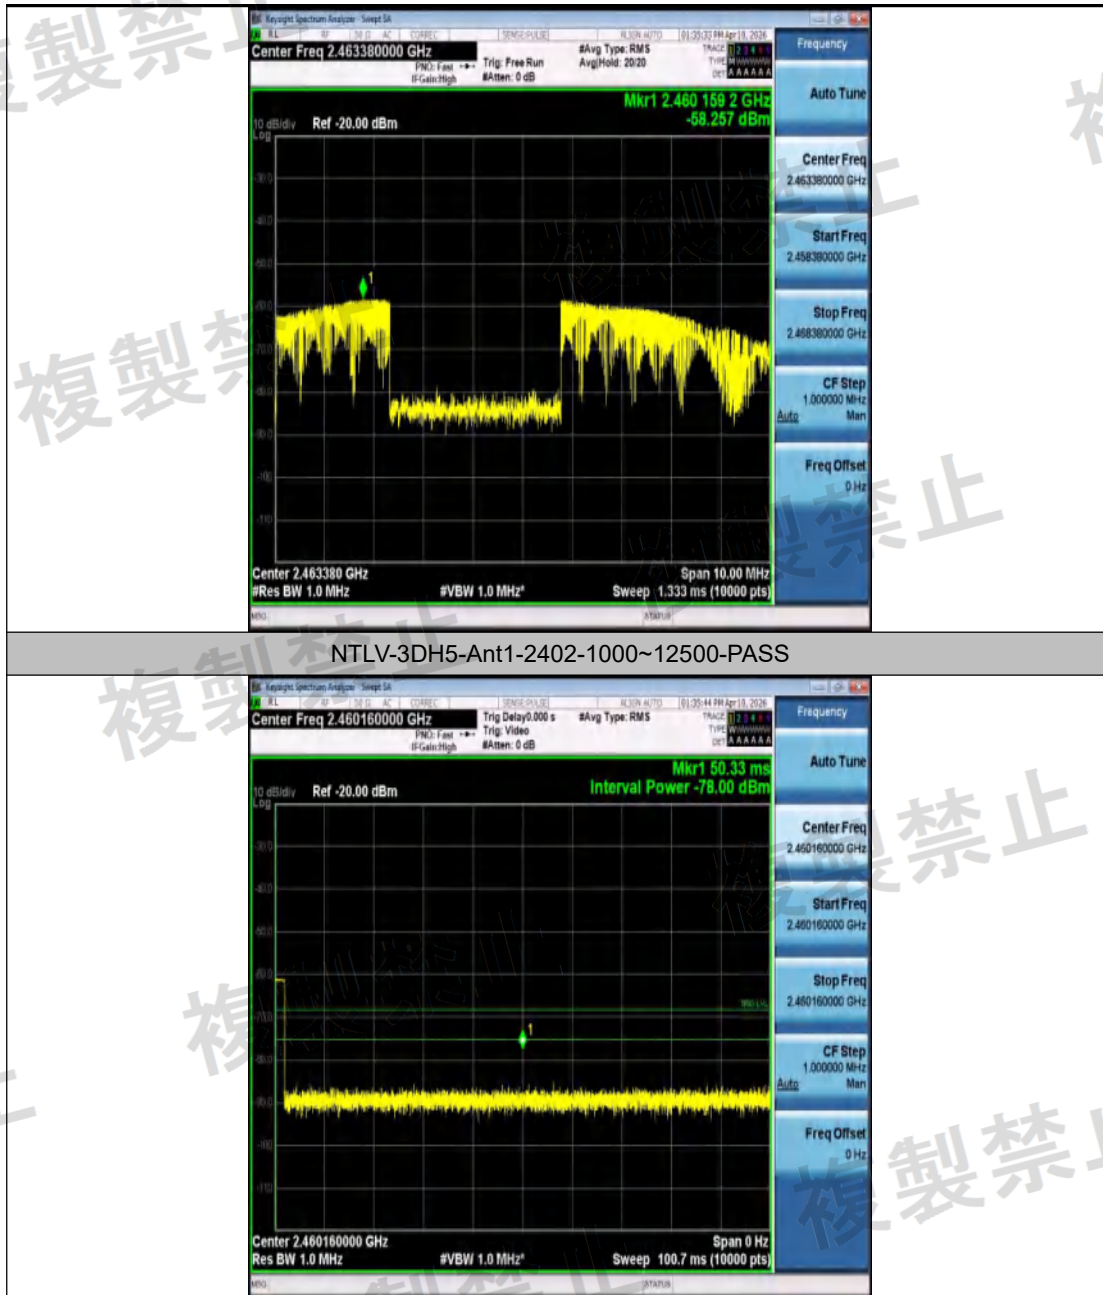


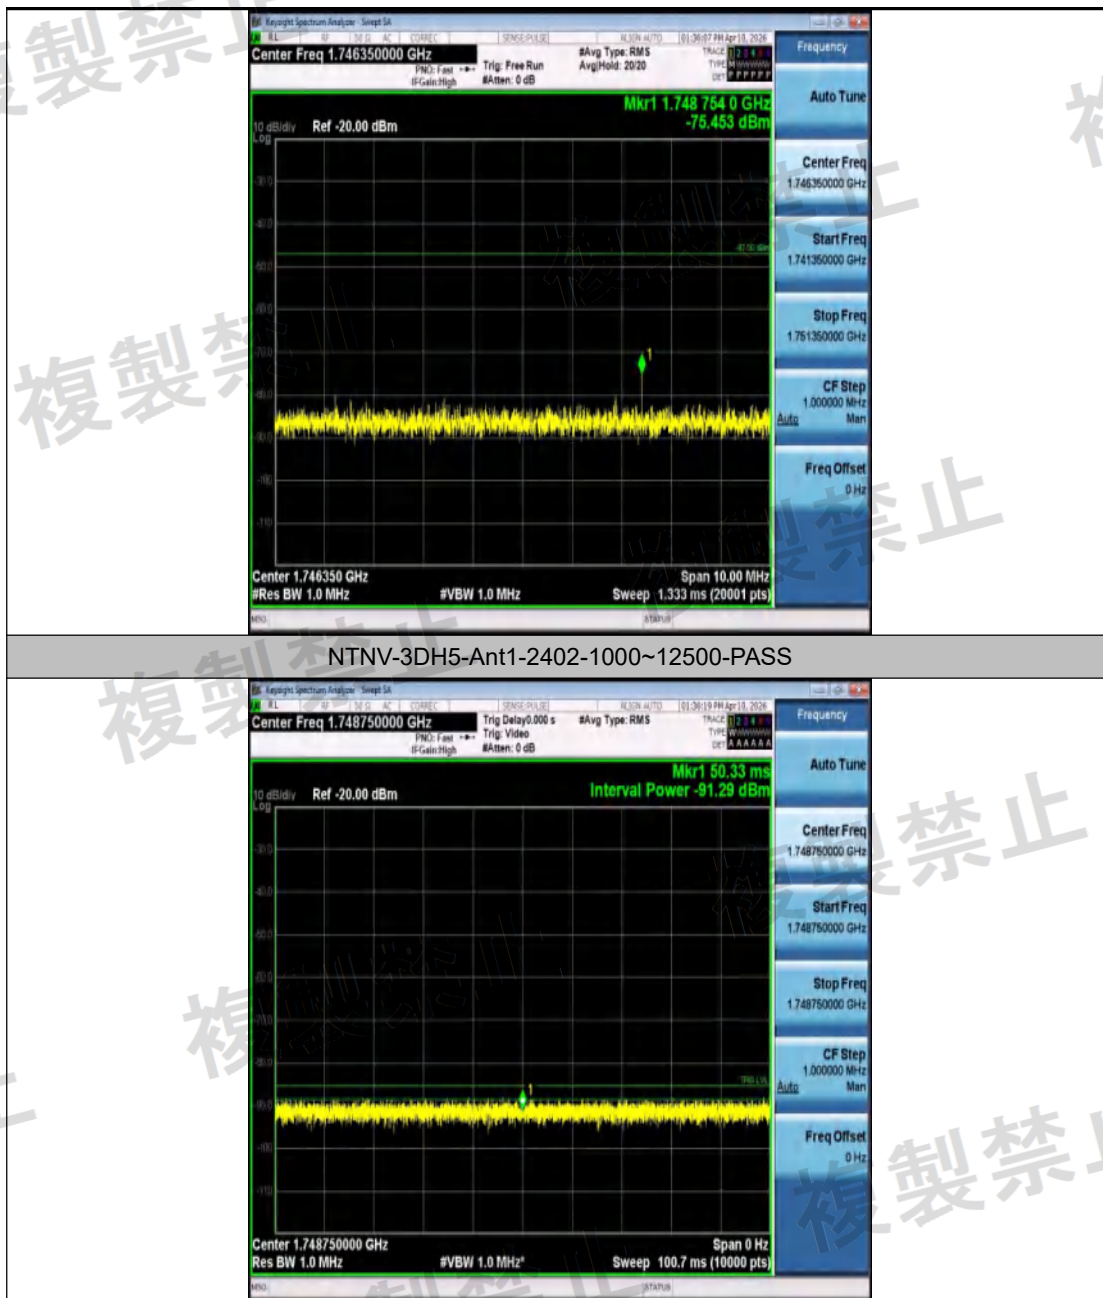


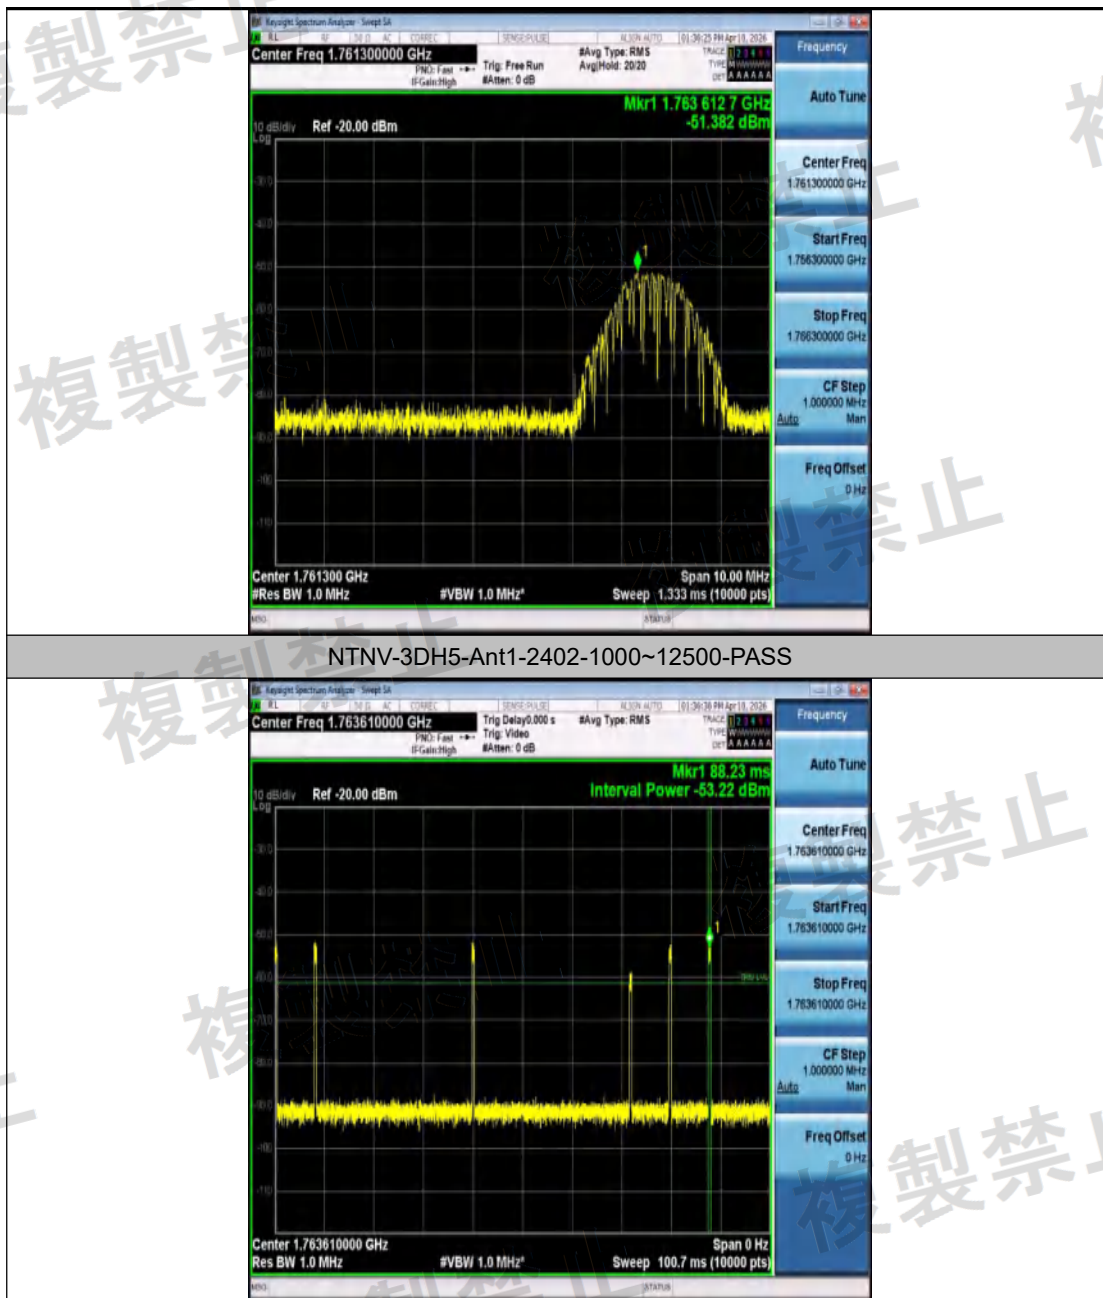


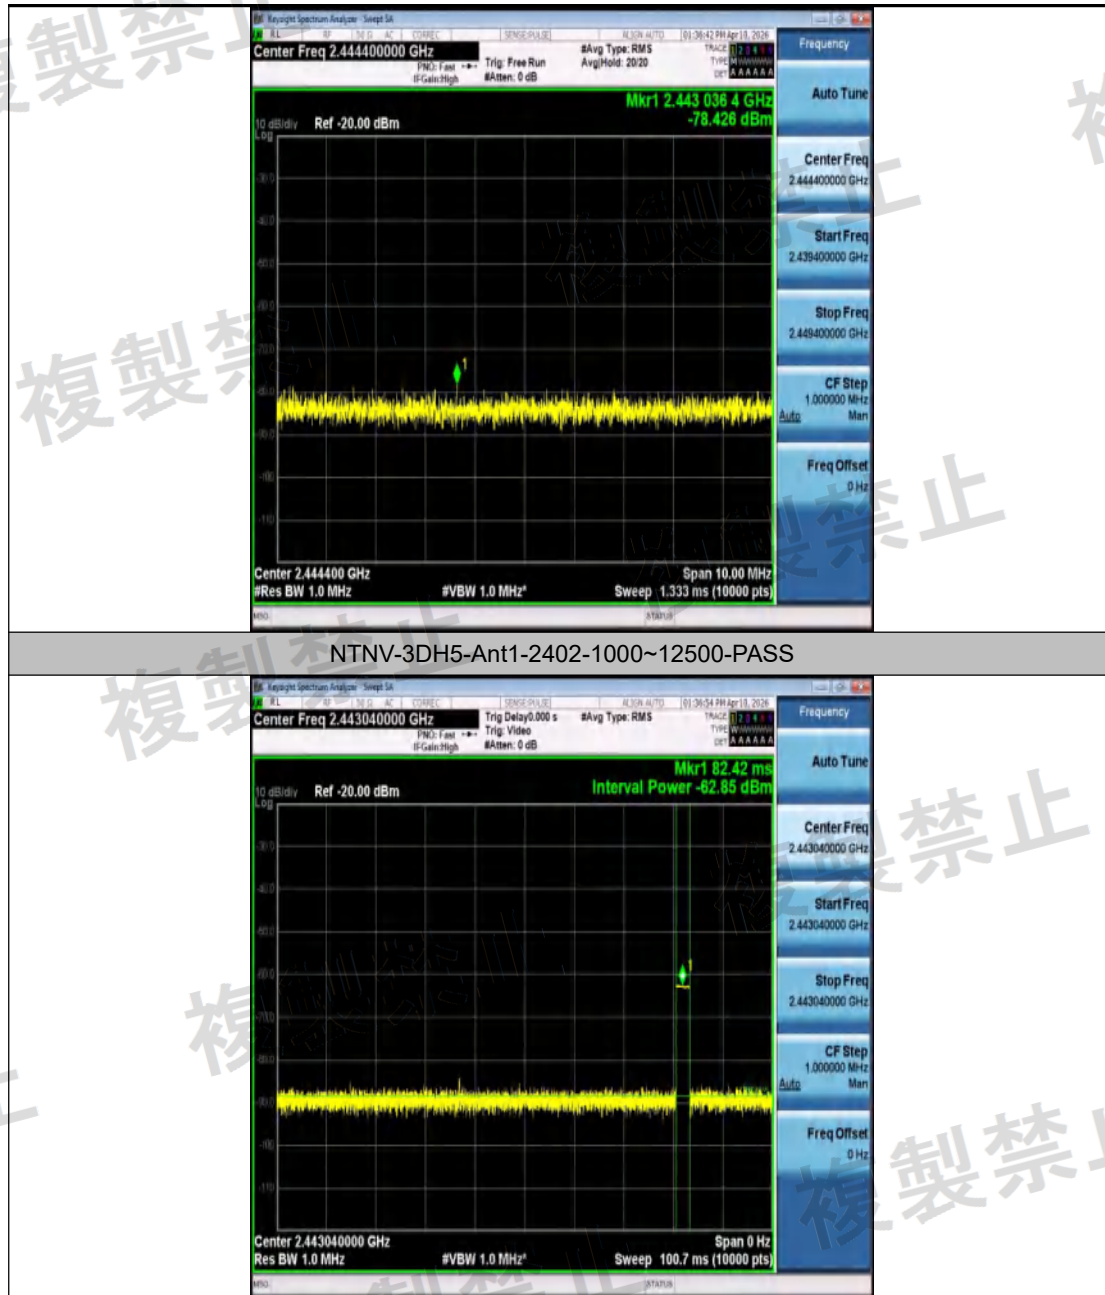


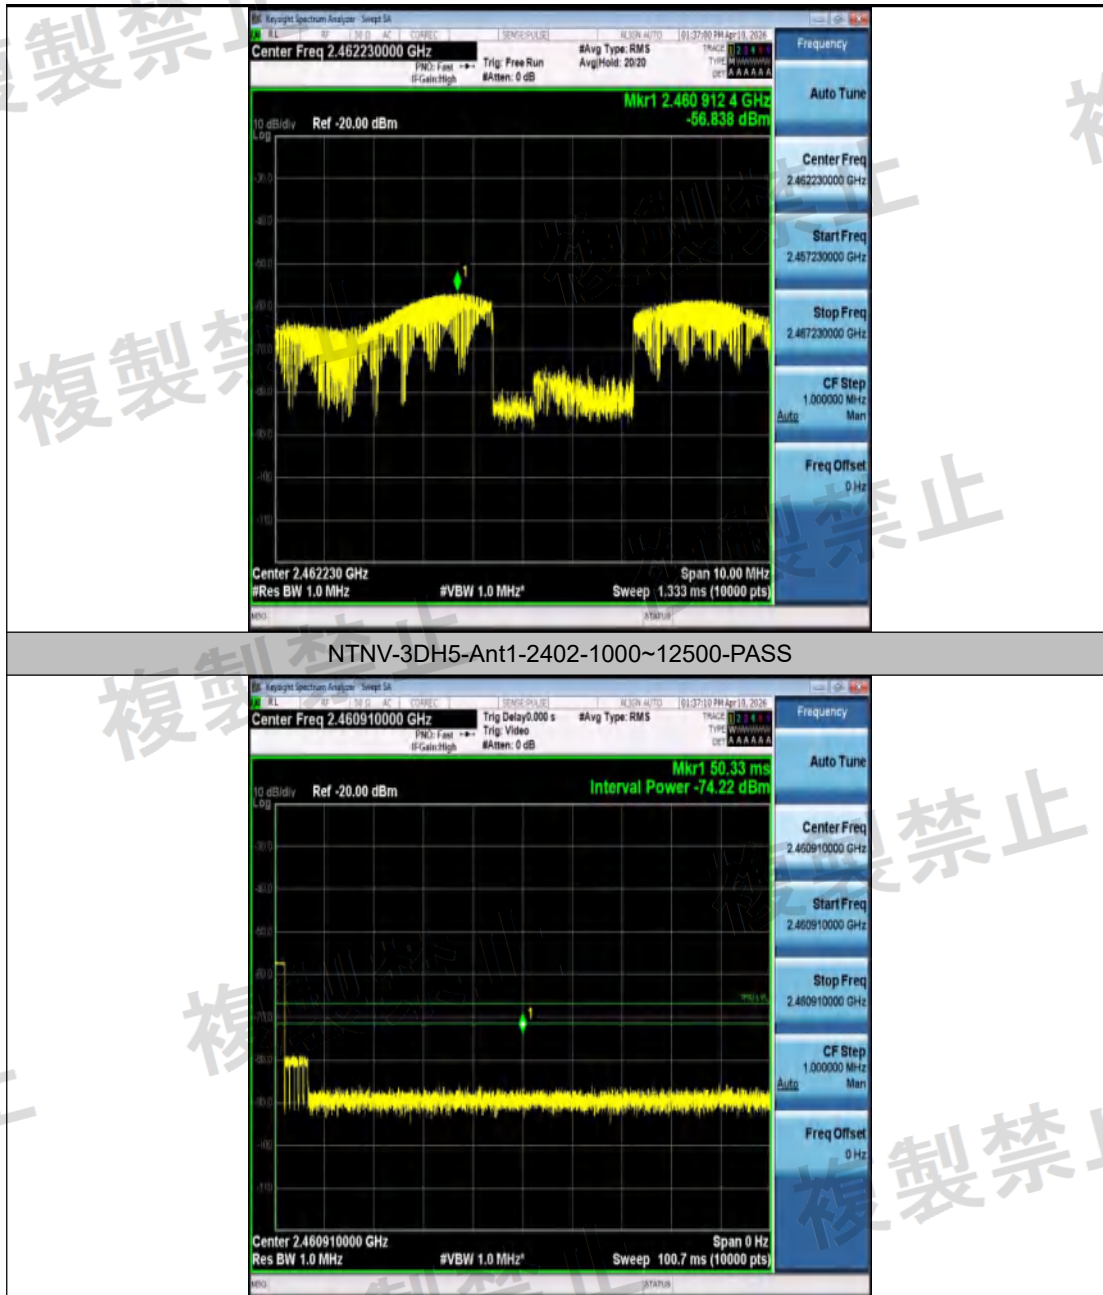


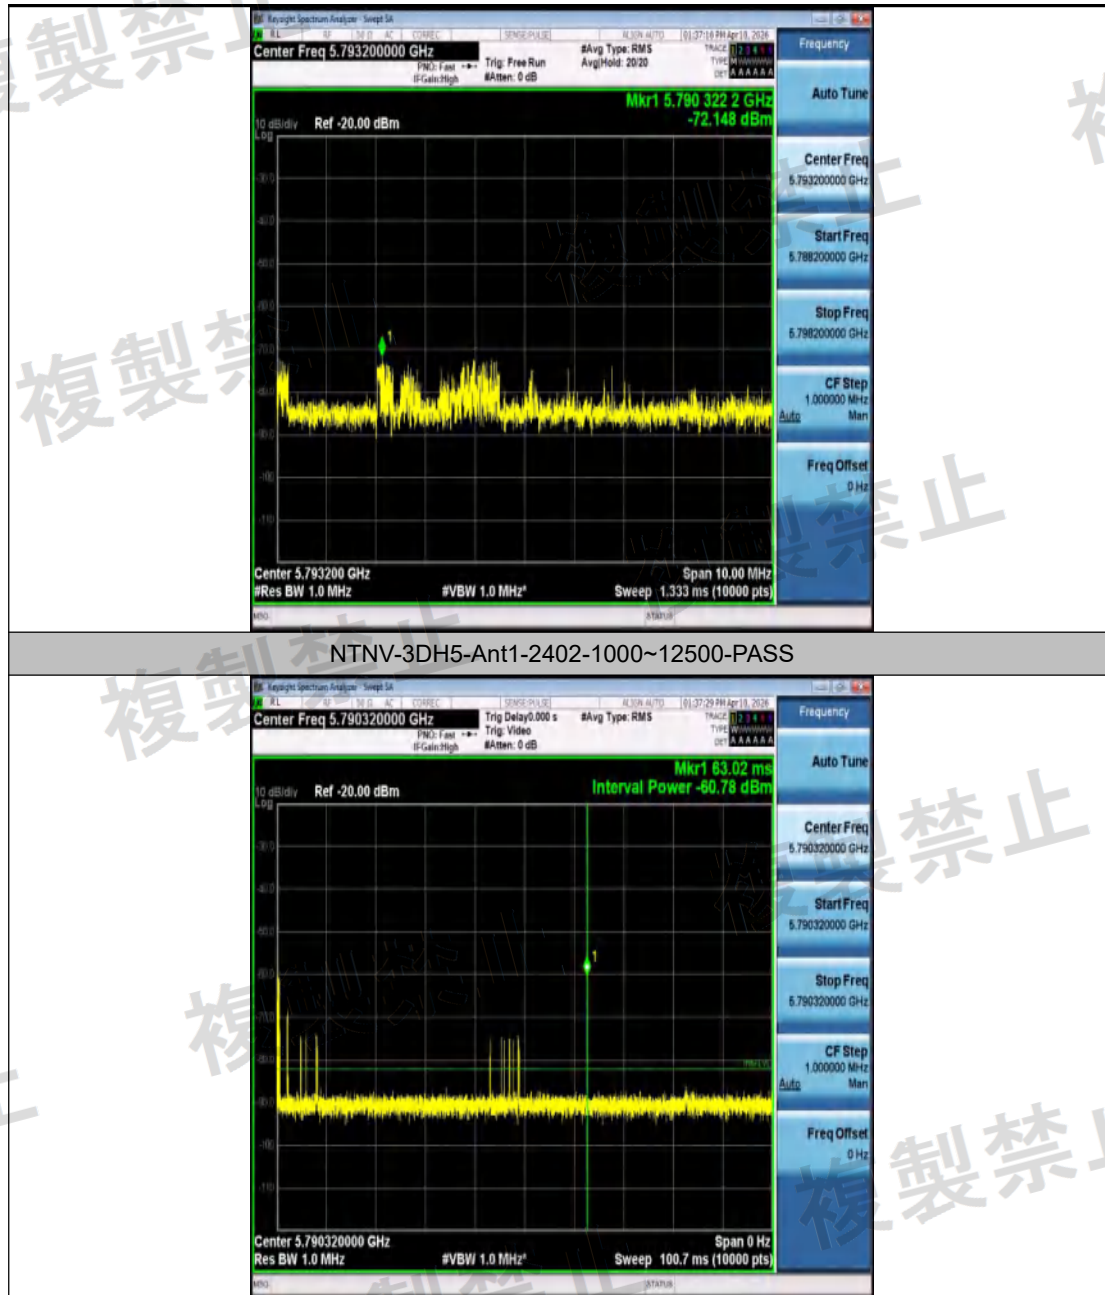


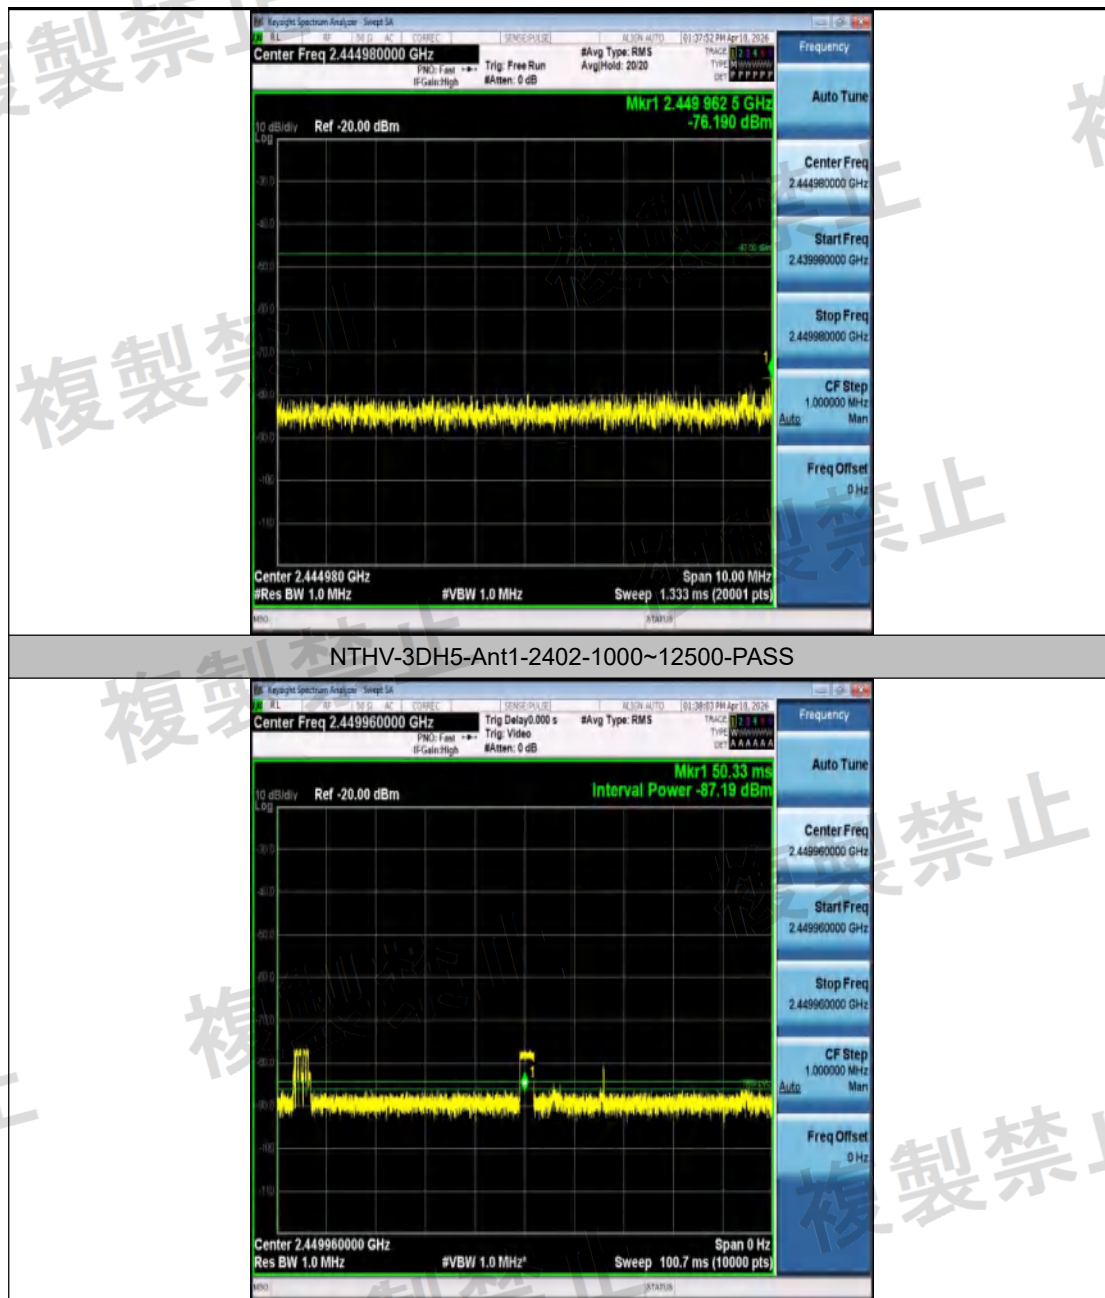


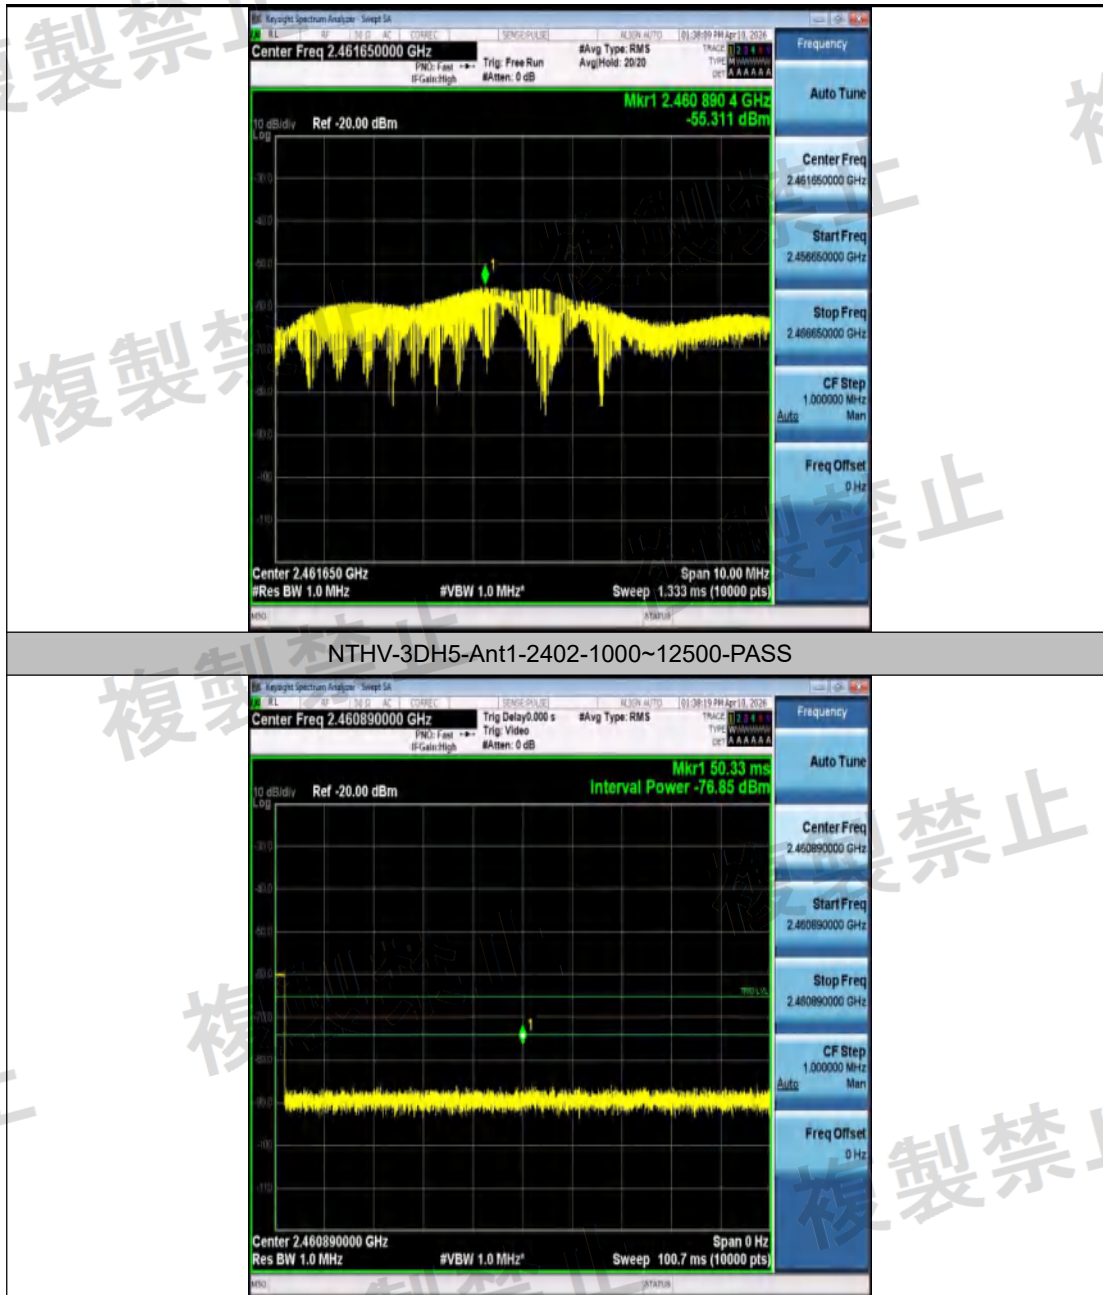


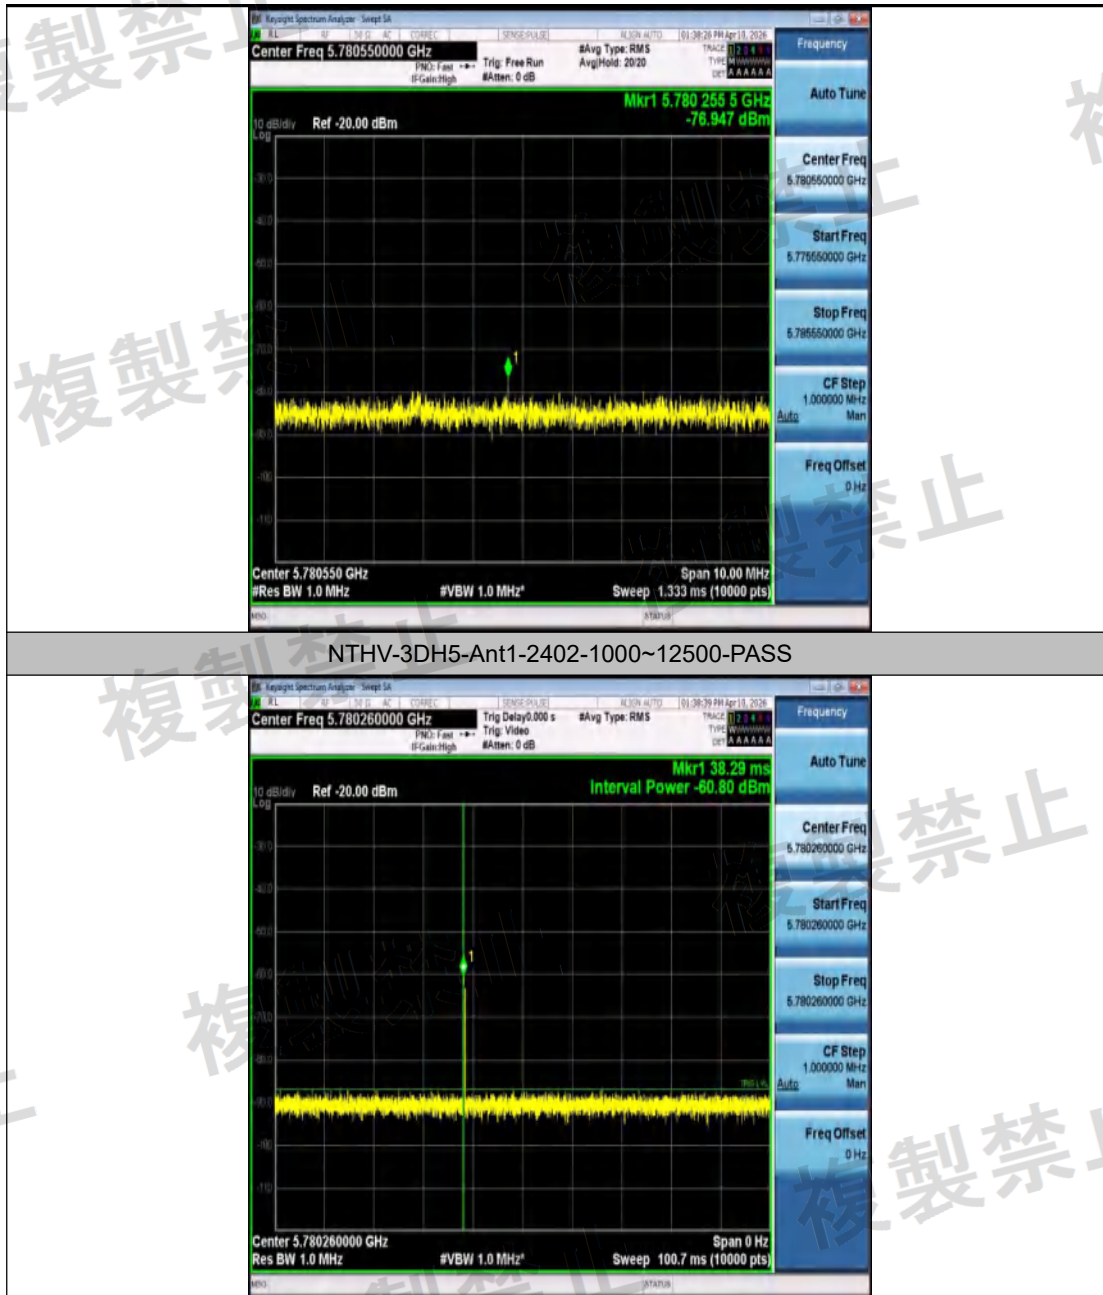


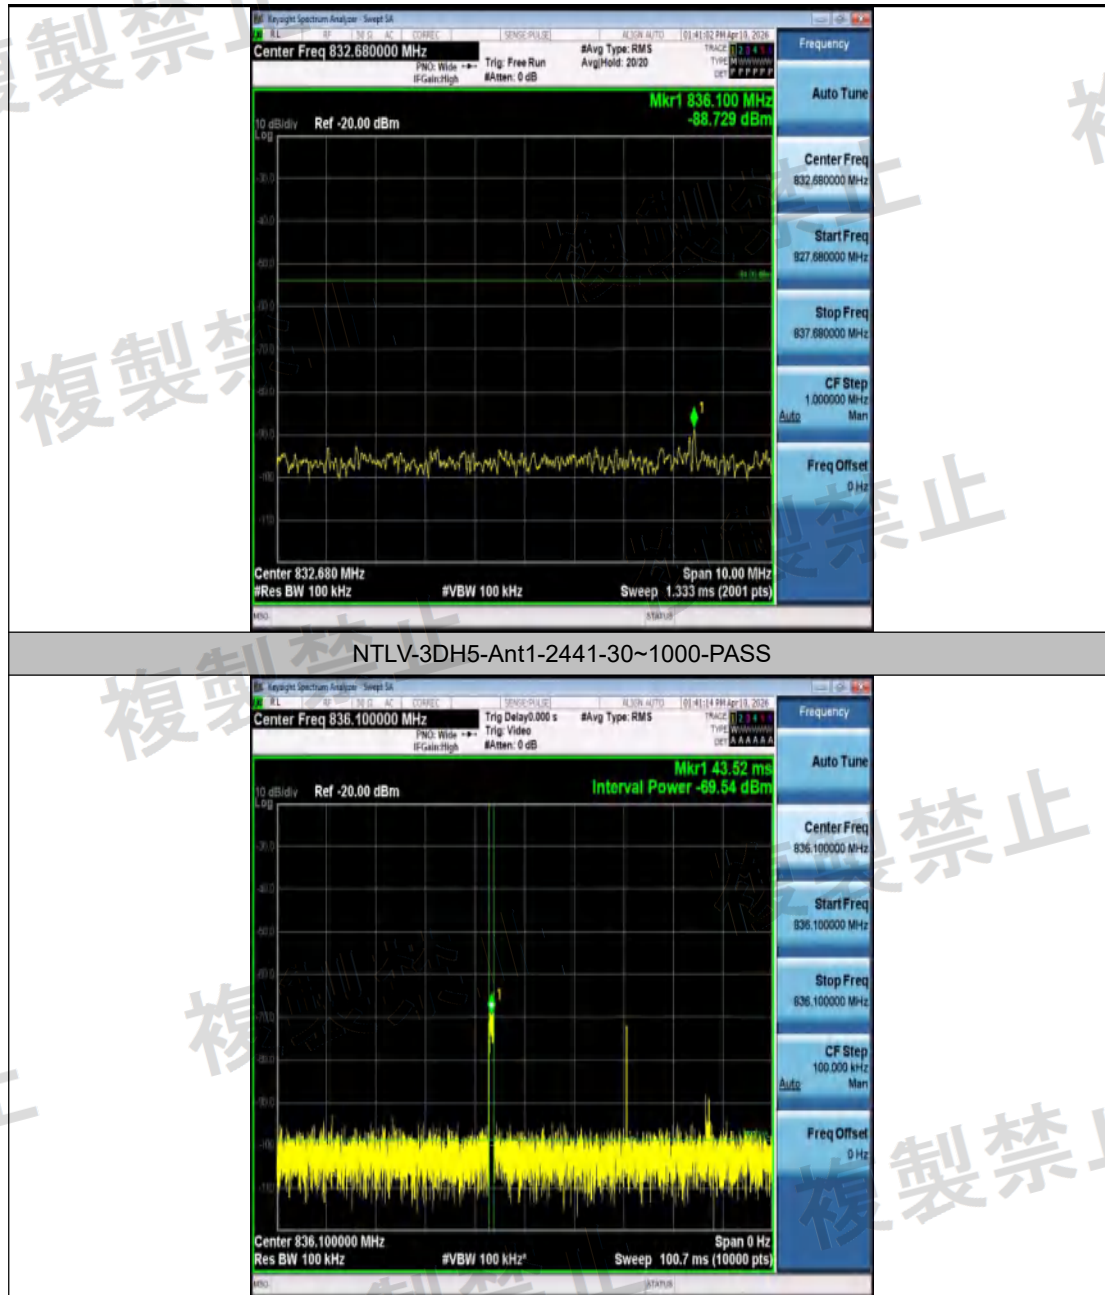


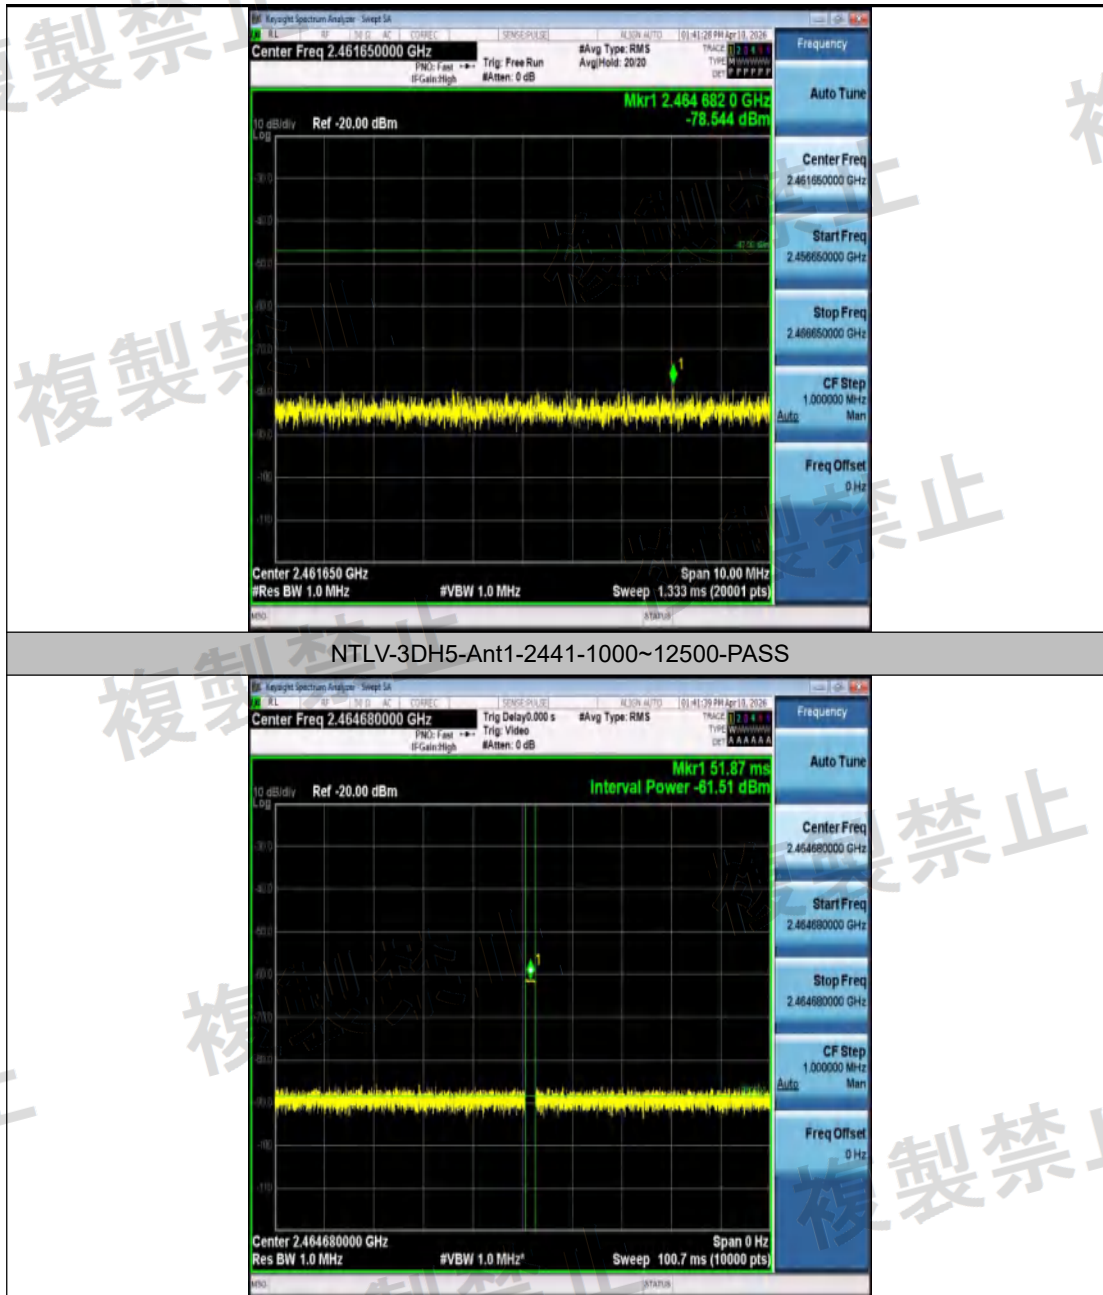


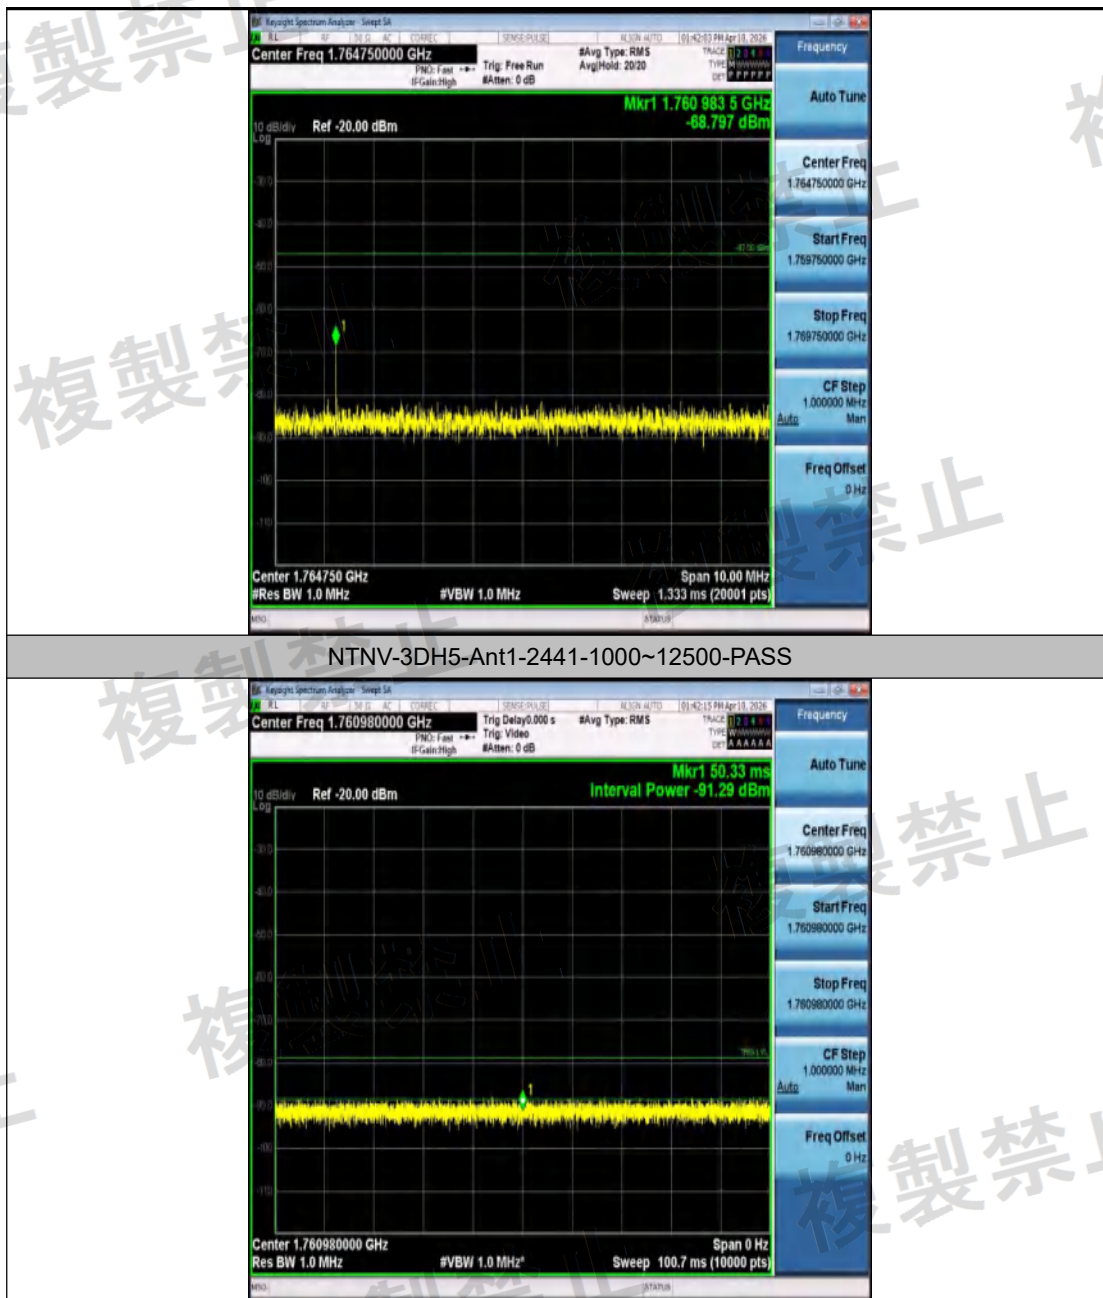


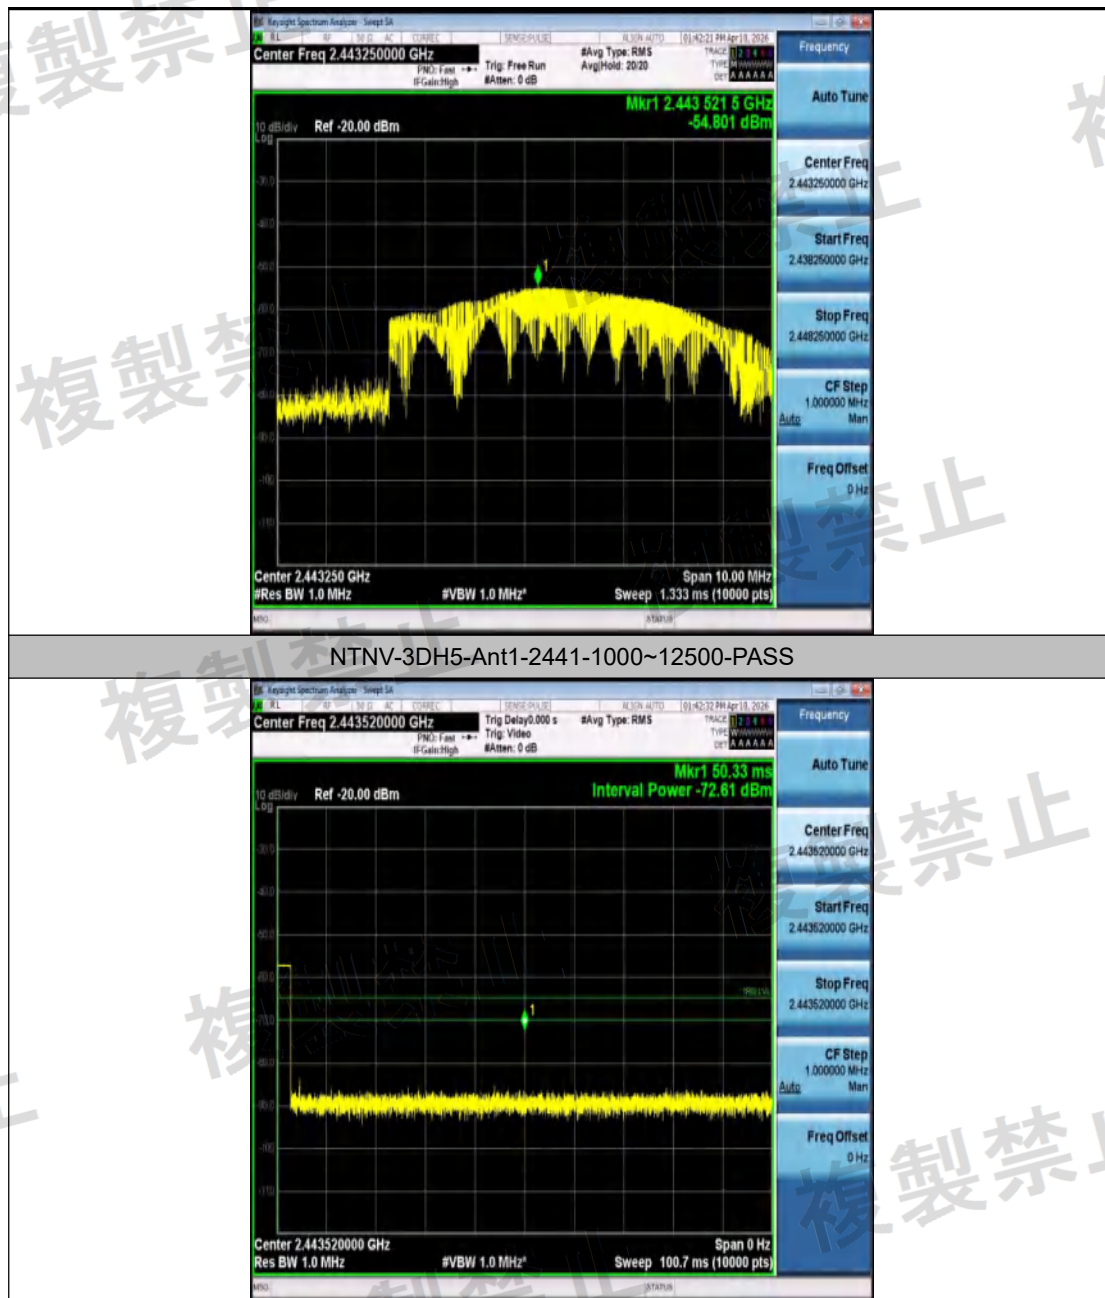


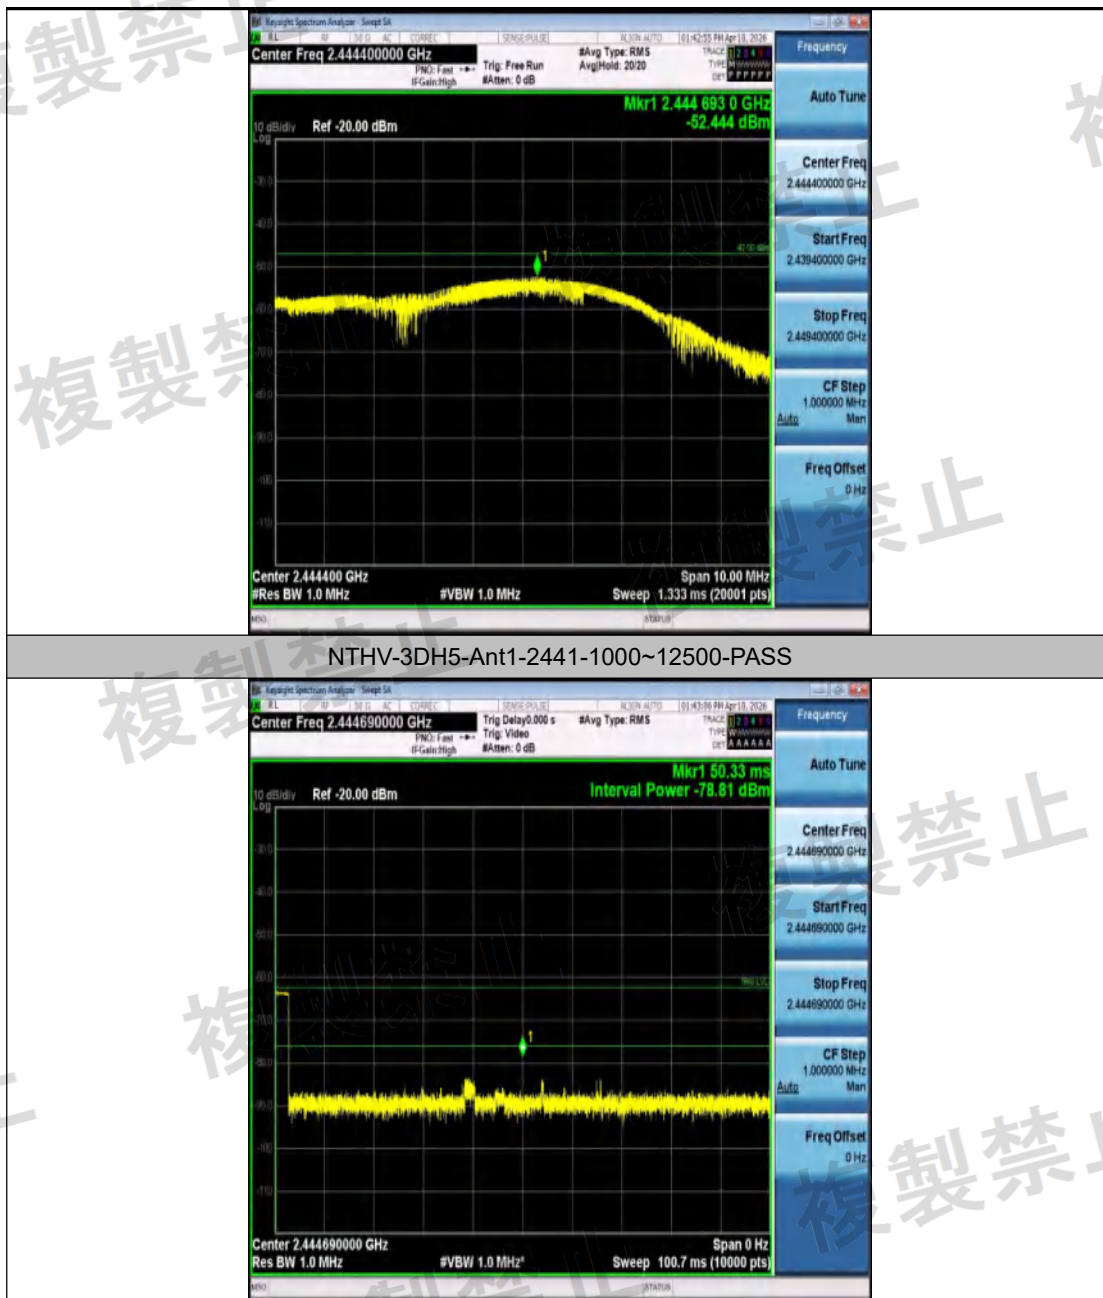


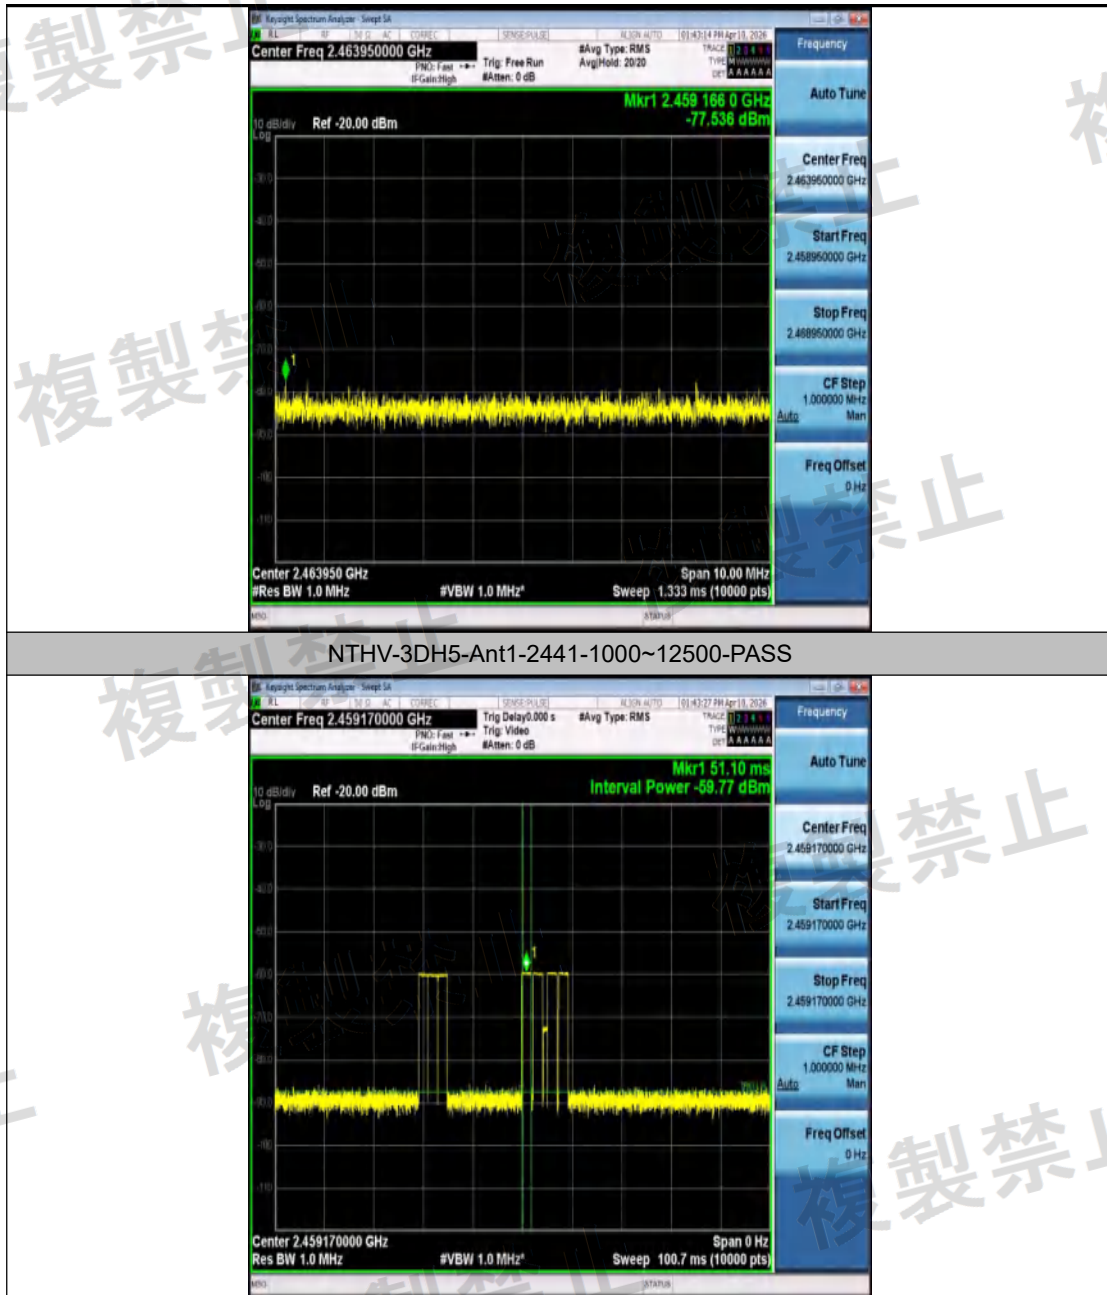


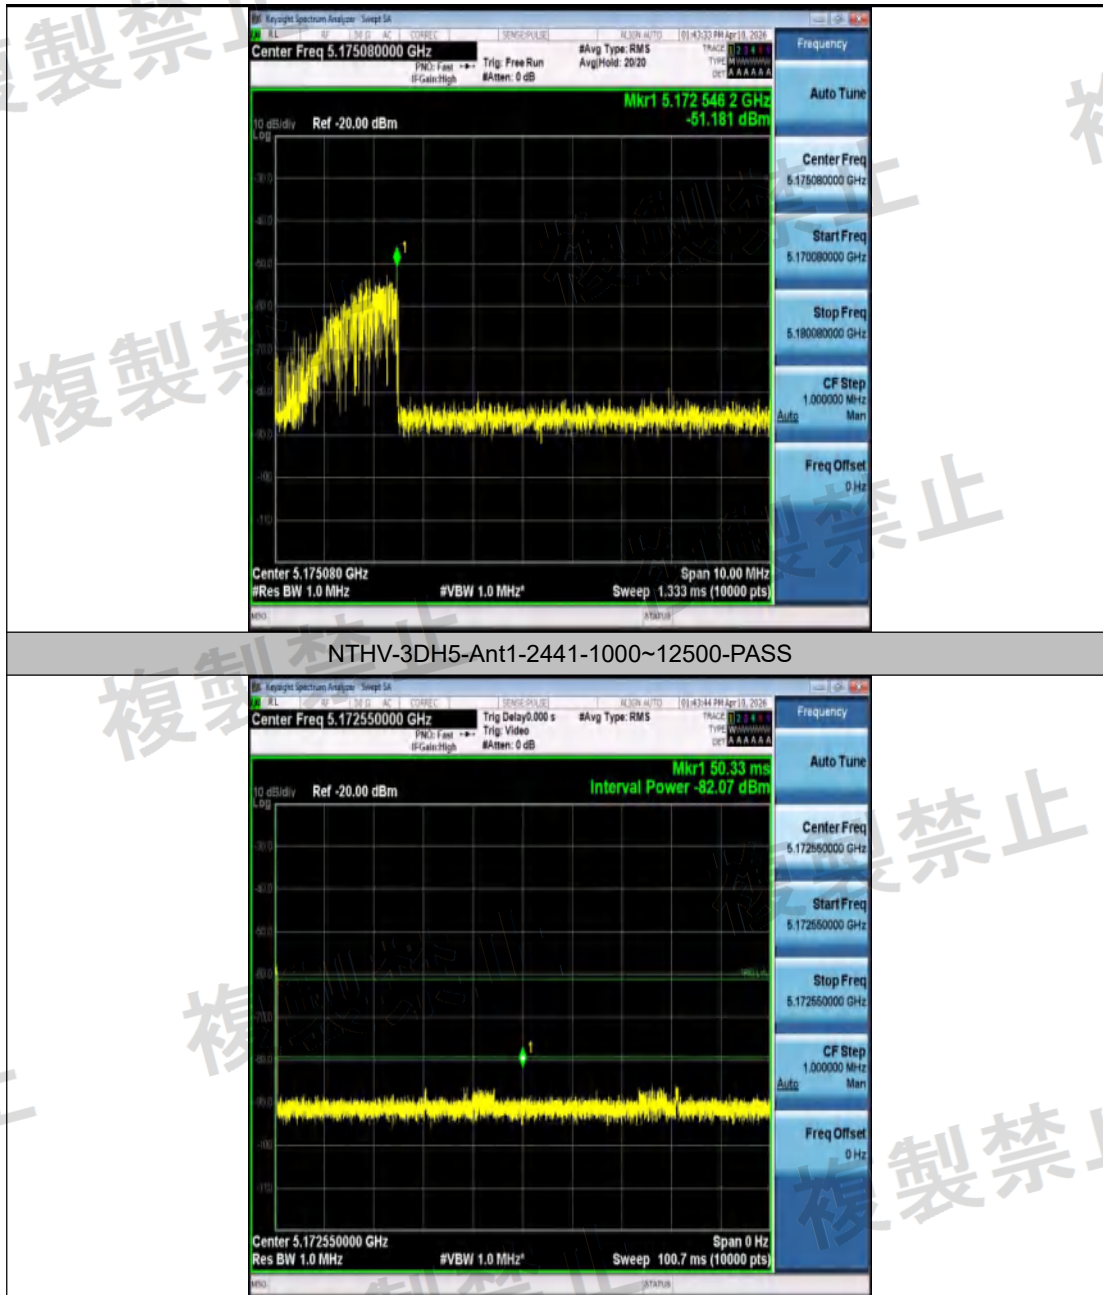

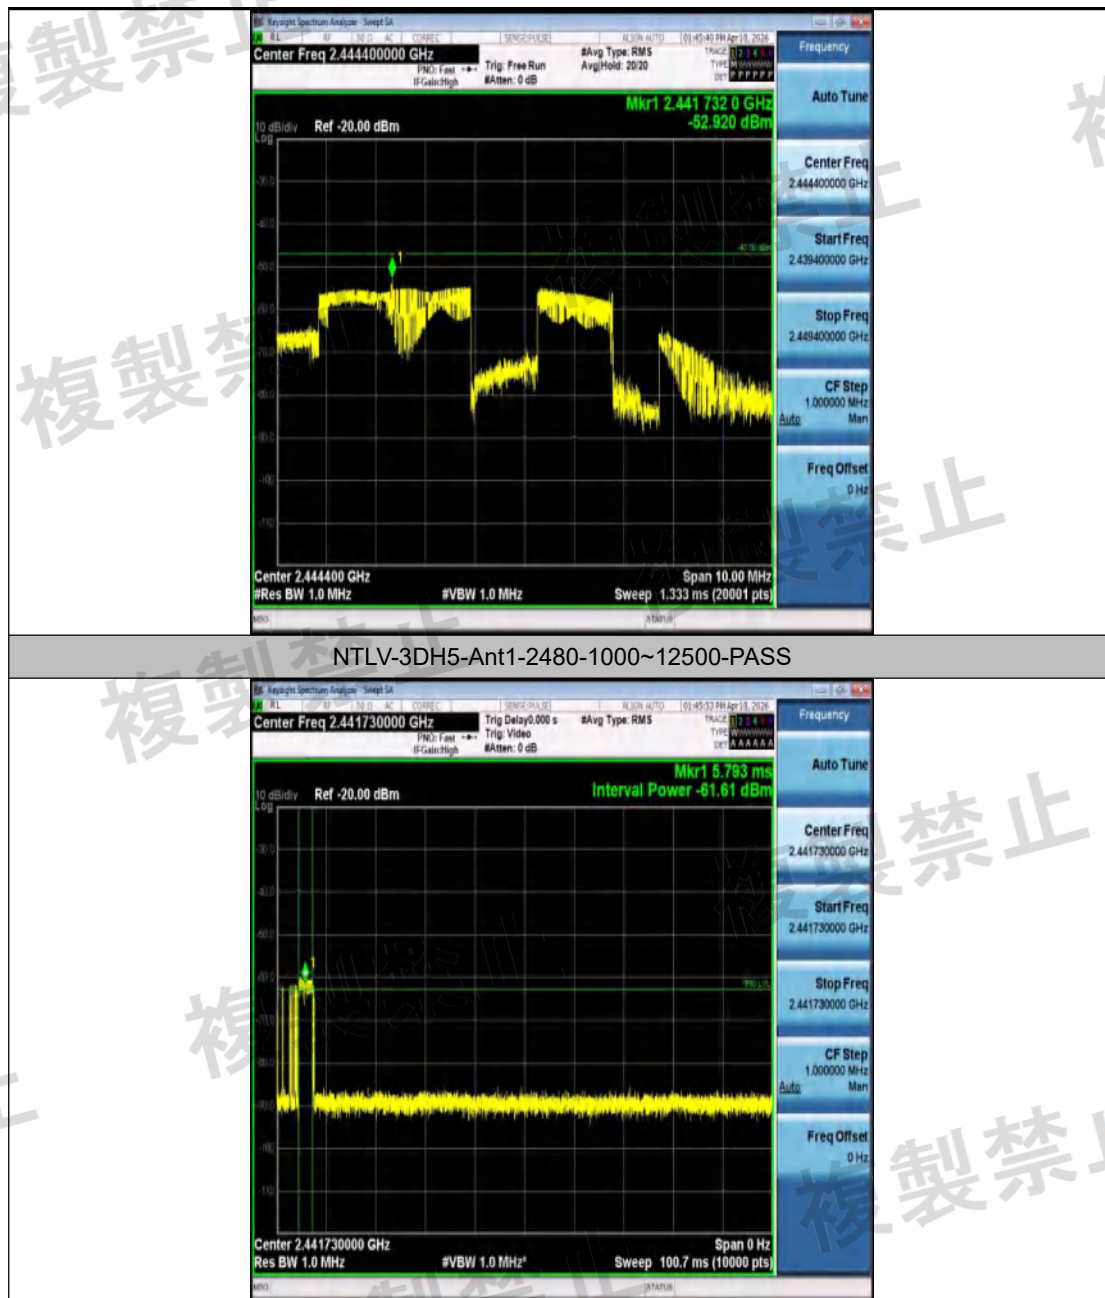

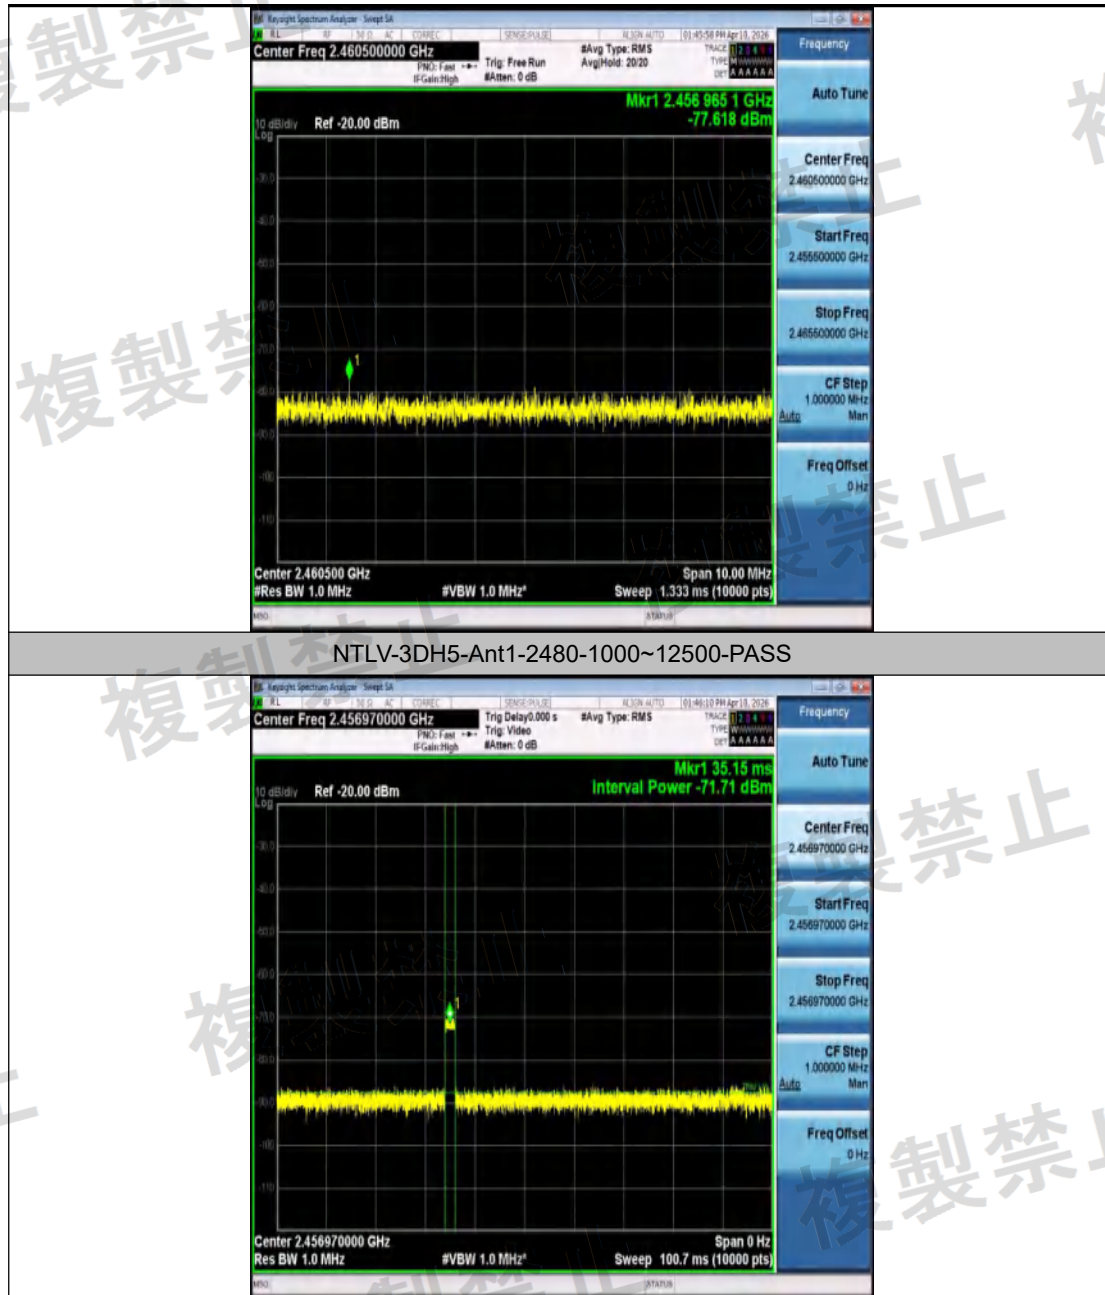

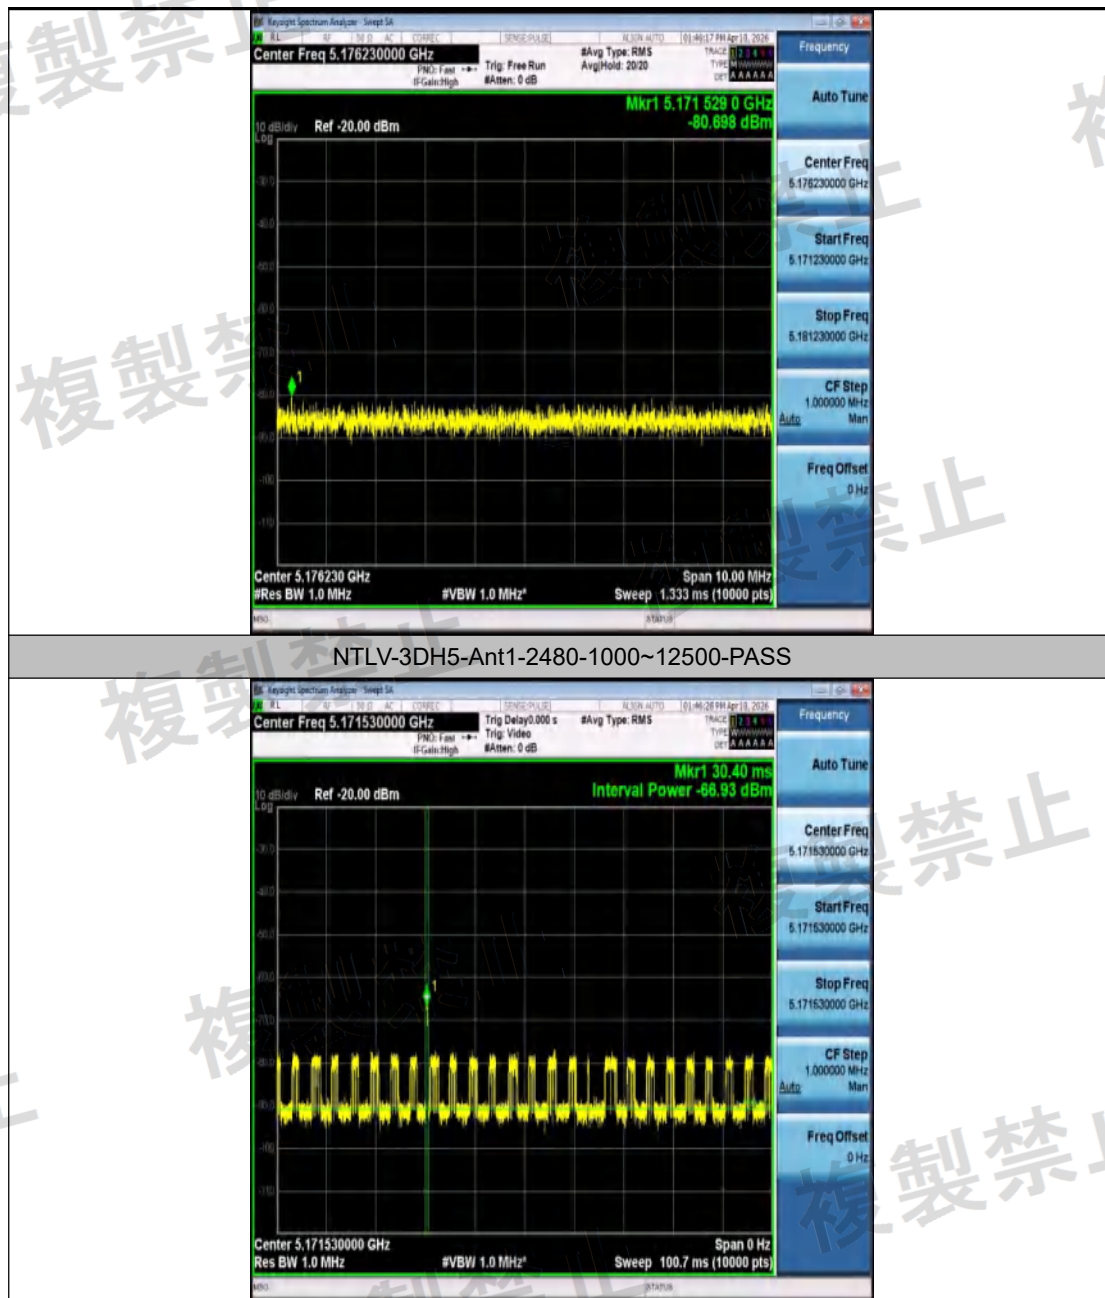

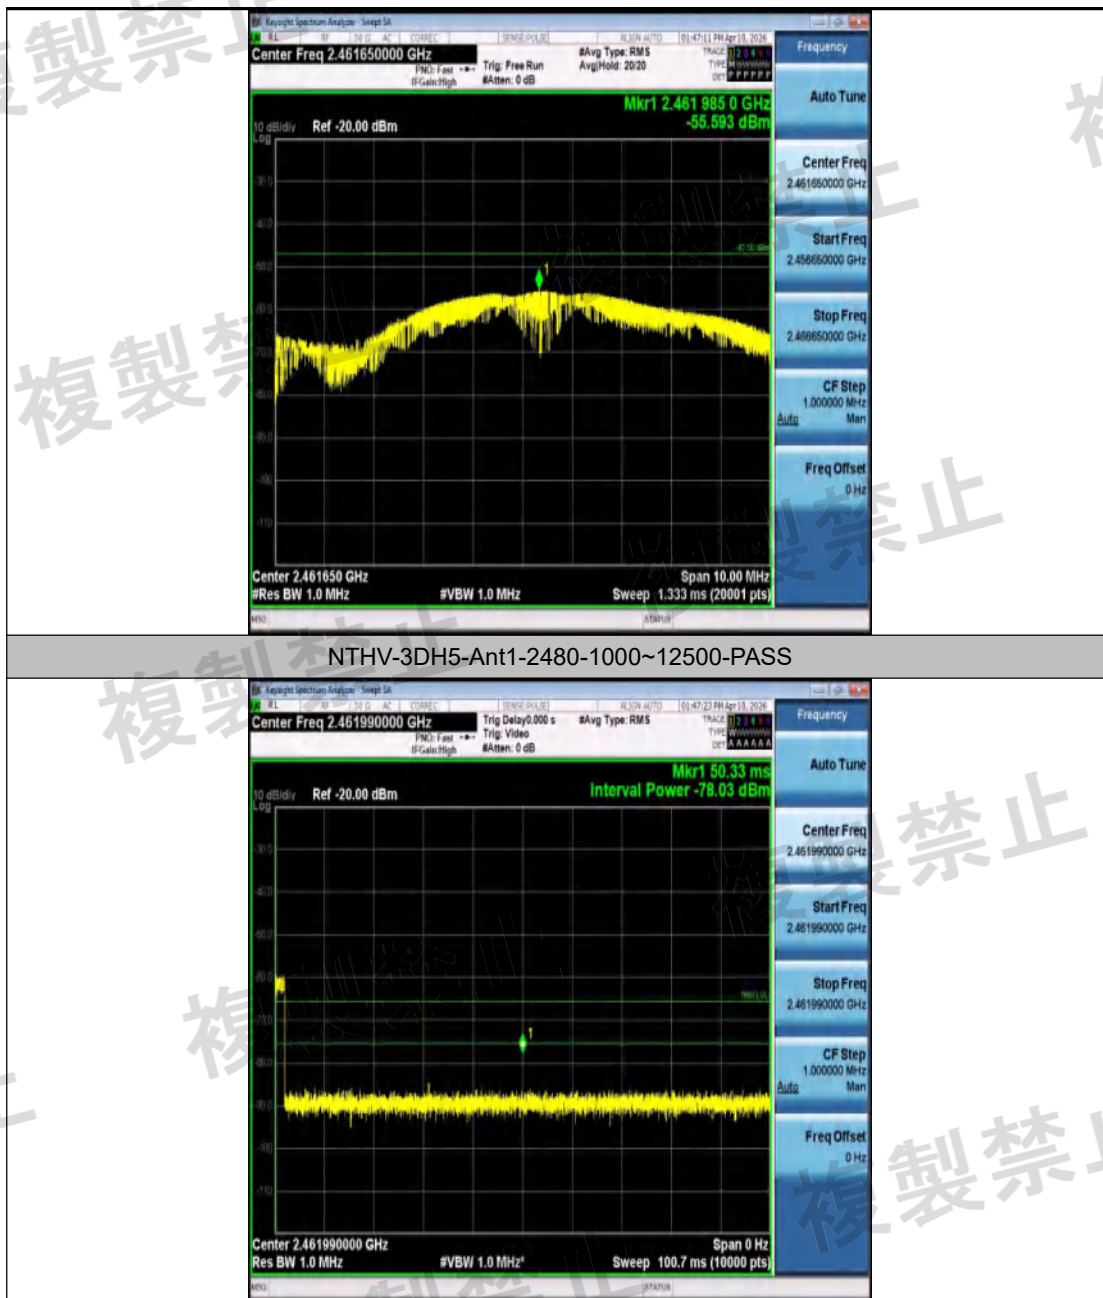


Appendix G: Dwell Time

Test Result

Test Condition	Test Mode	Antenna	Frequency [MHz]	BurstWidth [ms]	TotalHops [Num]	Result[s]	Limit [s]	Verdict
NTLV	DH5	Ant1	Hop	2.90	121	0.351	≤0.4	PASS
NTNV	DH5	Ant1	Hop	2.90	125	0.363	≤0.4	PASS
NTHV	DH5	Ant1	Hop	2.90	109	0.316	≤0.4	PASS
NTLV	2DH5	Ant1	Hop	2.90	107	0.31	≤0.4	PASS
NTNV	2DH5	Ant1	Hop	2.90	100	0.29	≤0.4	PASS
NTHV	2DH5	Ant1	Hop	2.90	113	0.328	≤0.4	PASS
NTLV	3DH5	Ant1	Hop	2.90	109	0.316	≤0.4	PASS
NTNV	3DH5	Ant1	Hop	2.90	117	0.339	≤0.4	PASS
NTHV	3DH5	Ant1	Hop	2.90	113	0.328	≤0.4	PASS



Test Graphs

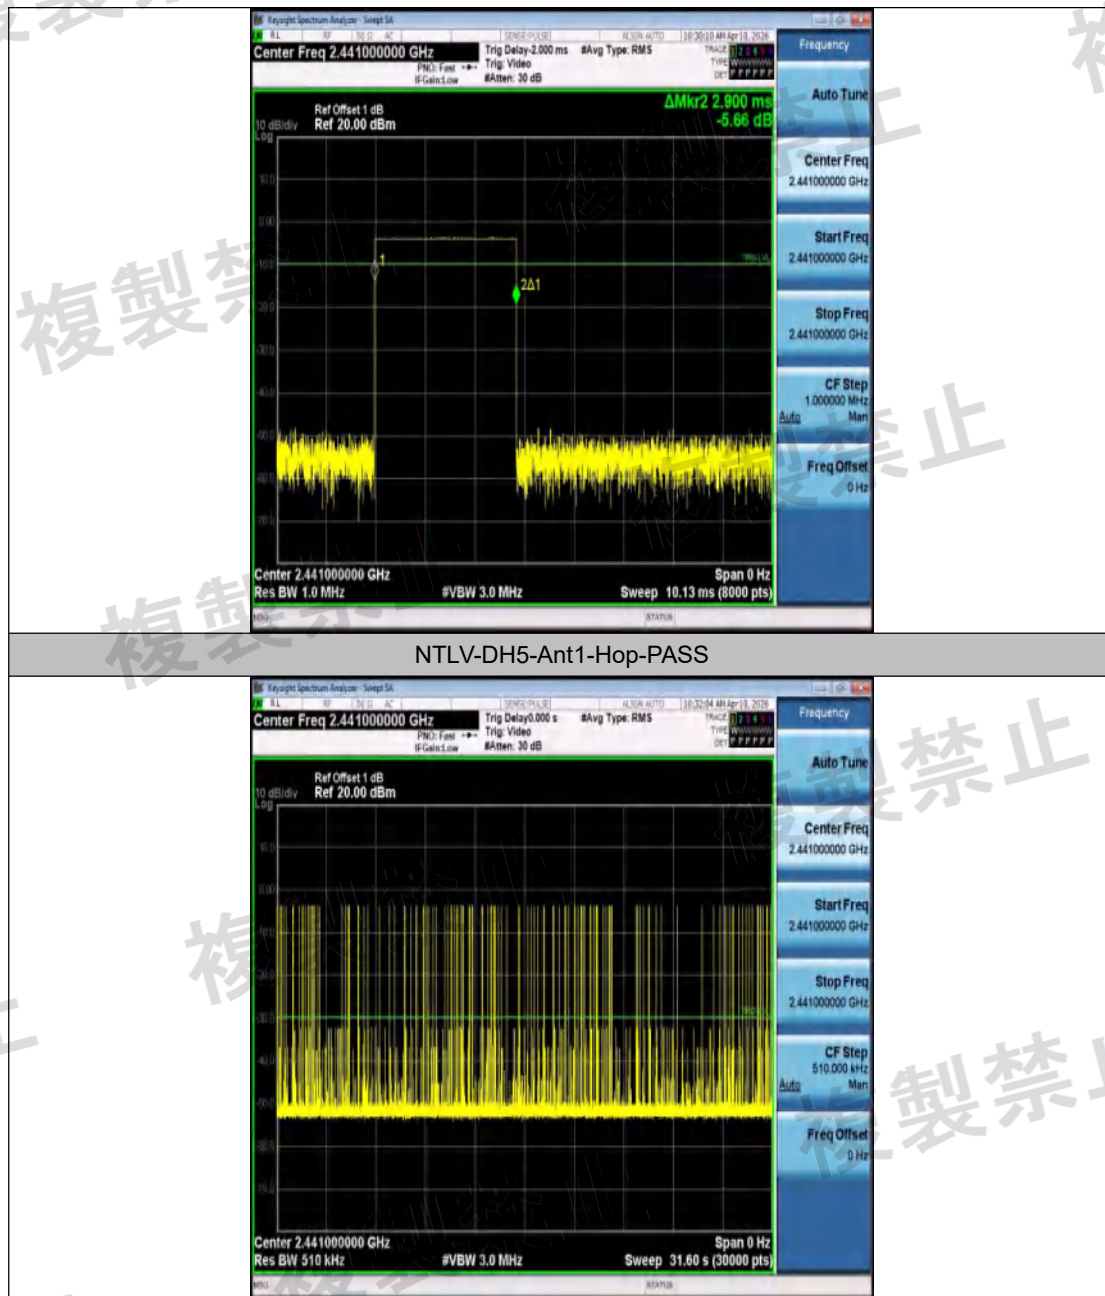

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China


Tel: (86) 0755-26066440 Email: service@anbotek.com





Hotline


400-003-0500


www.anbotek.com

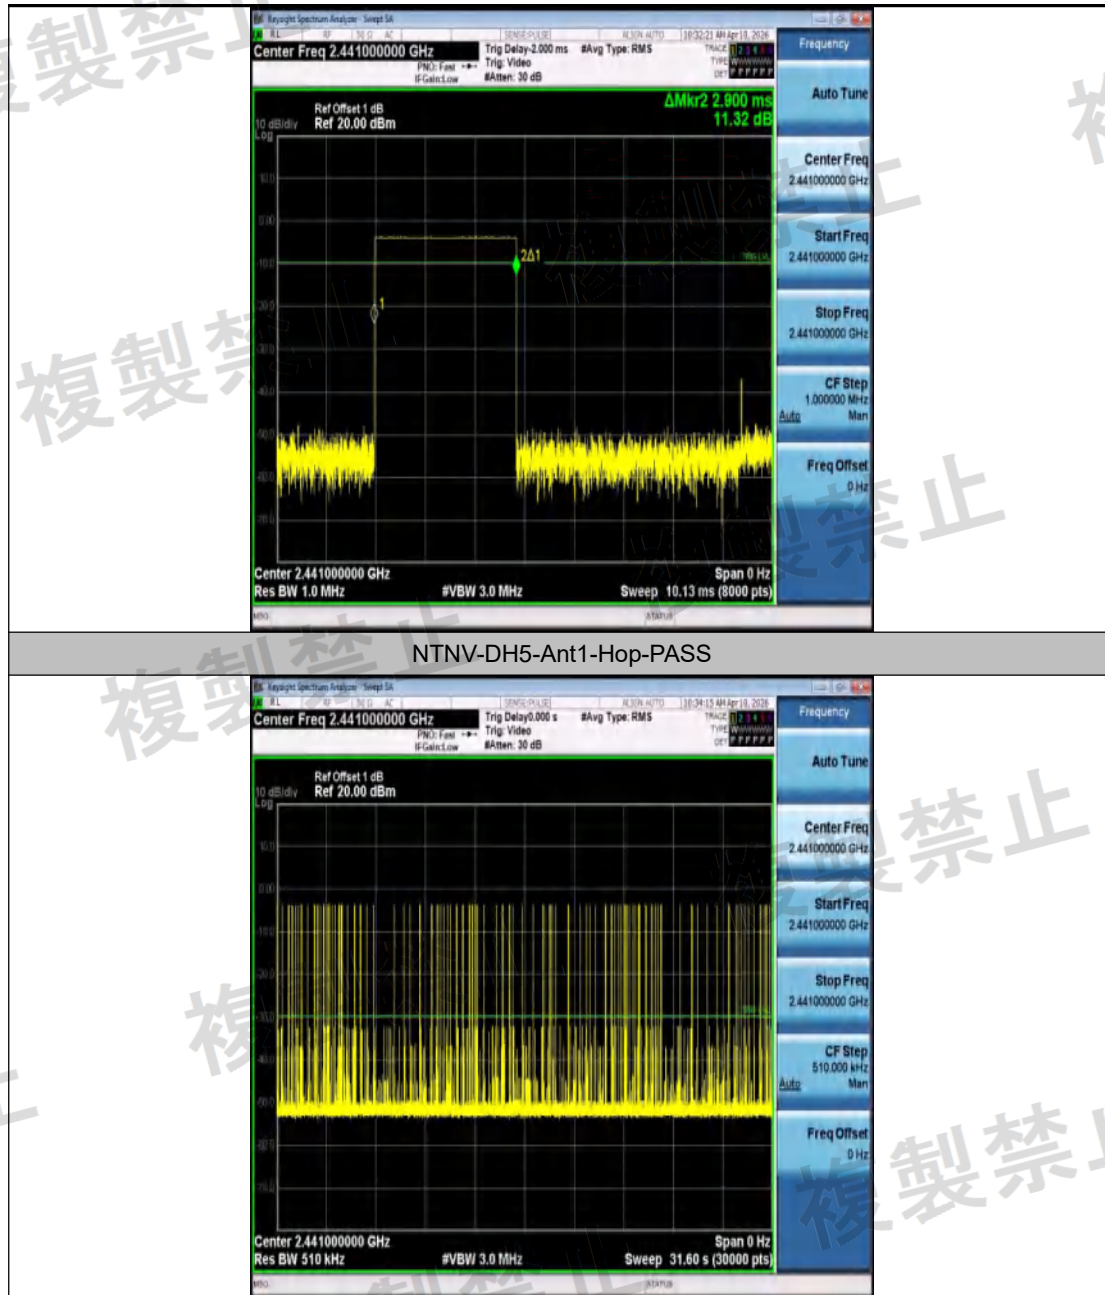


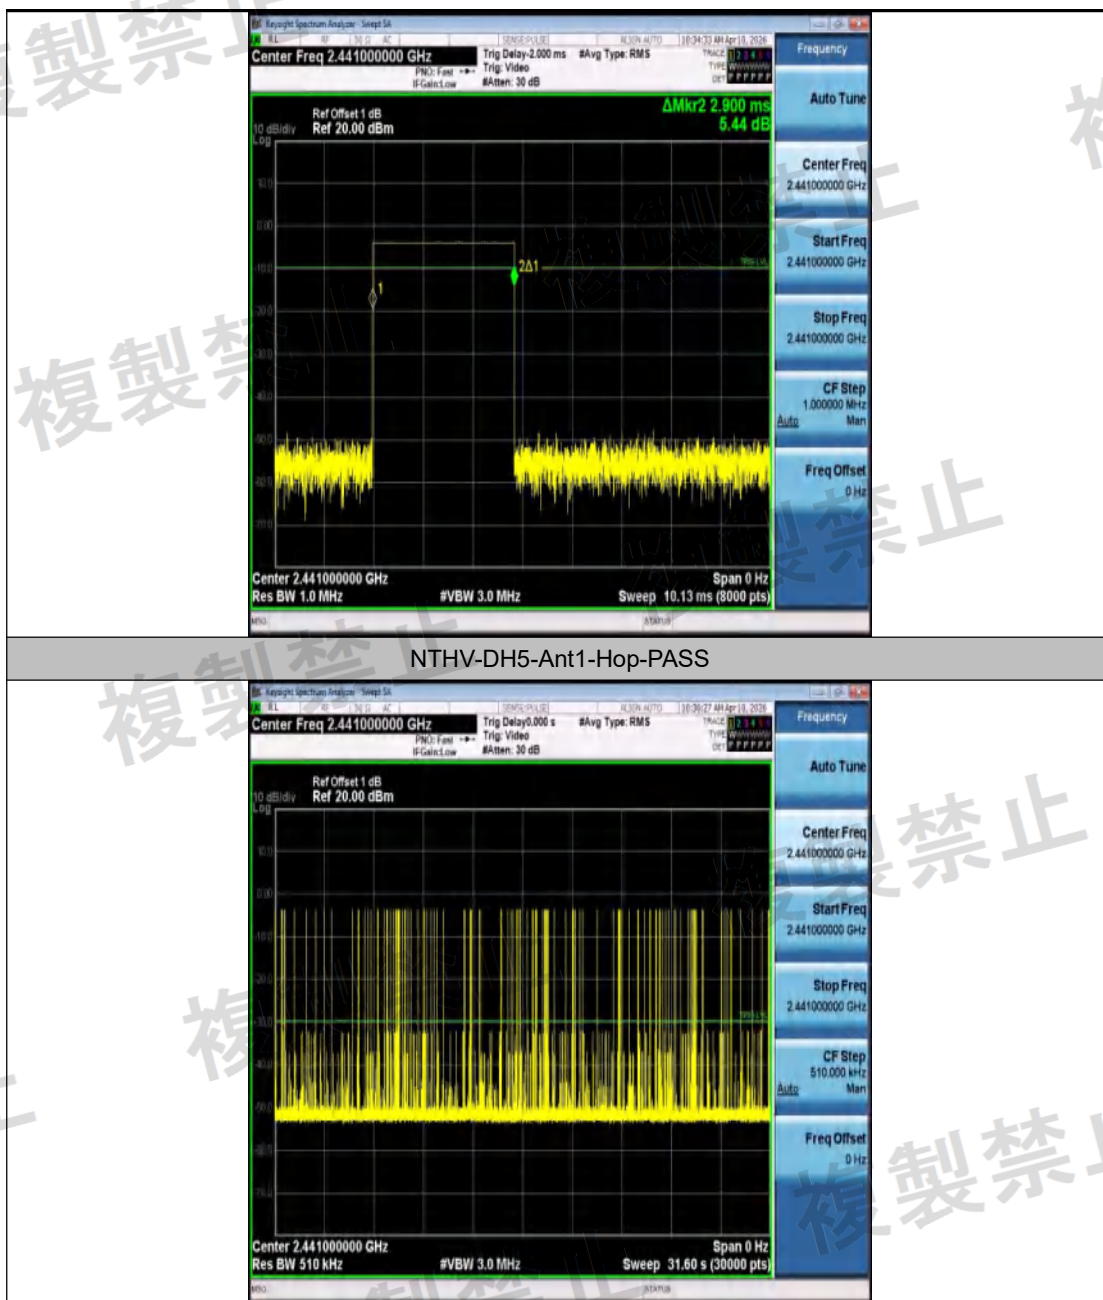


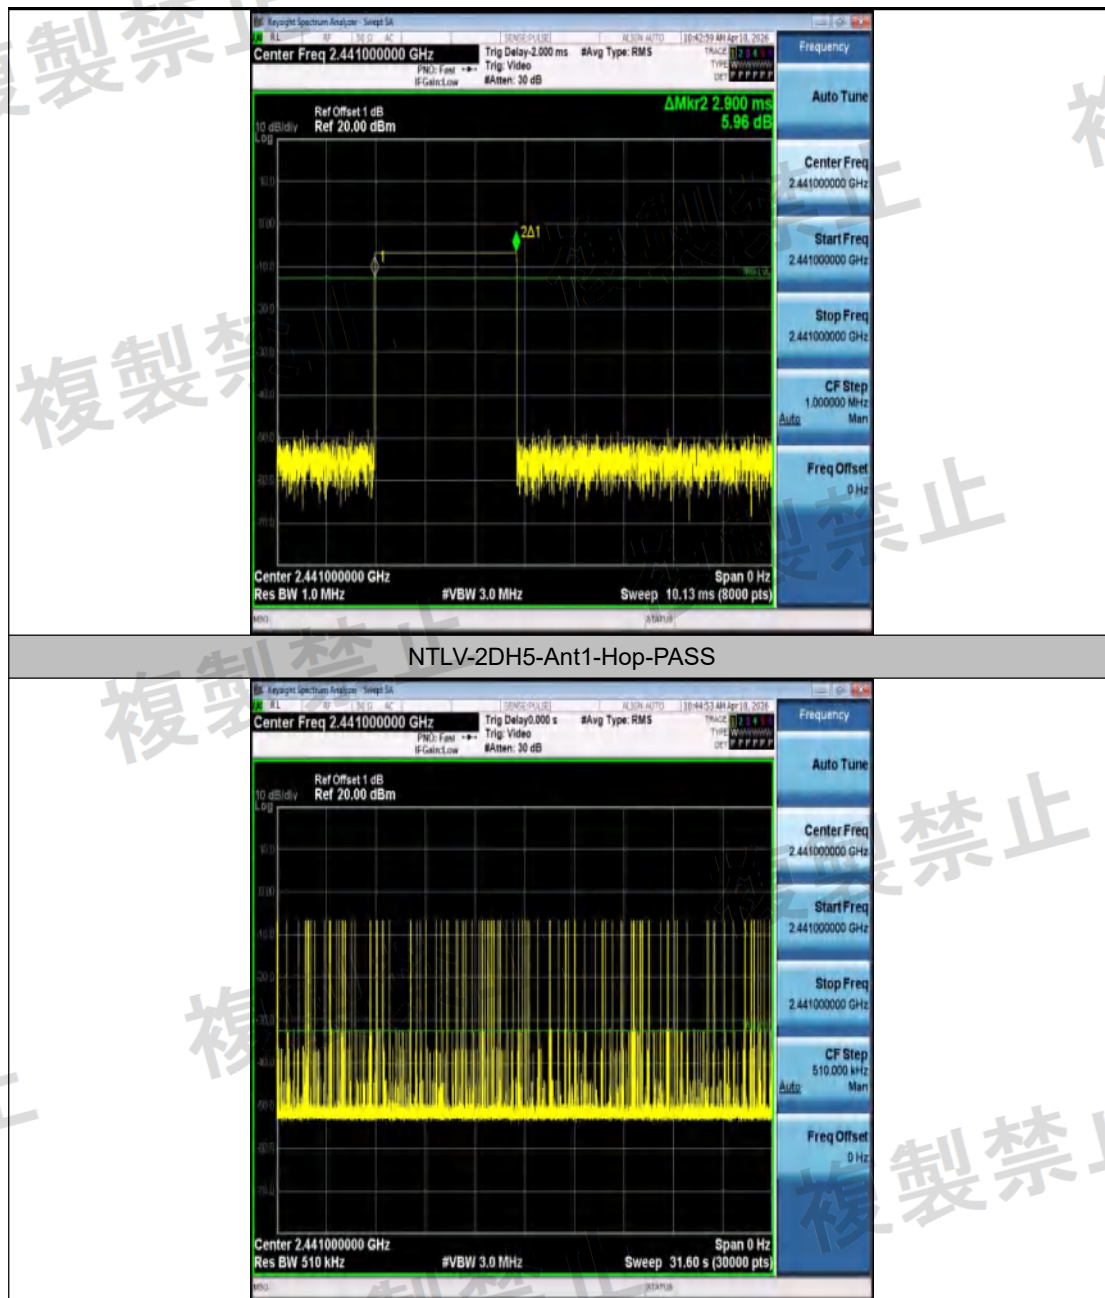


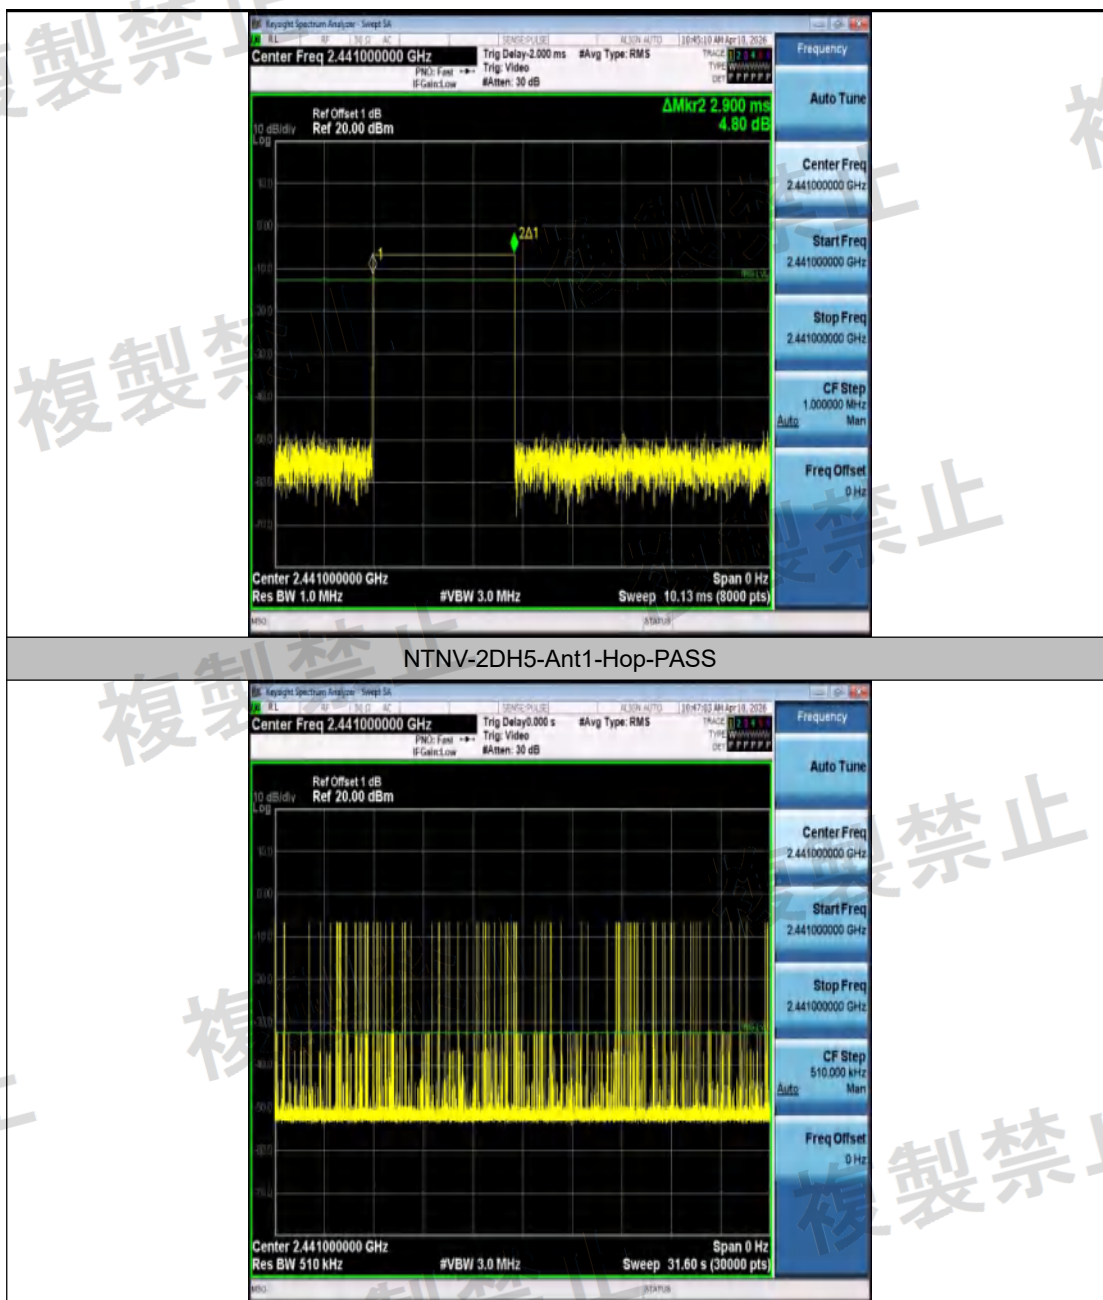

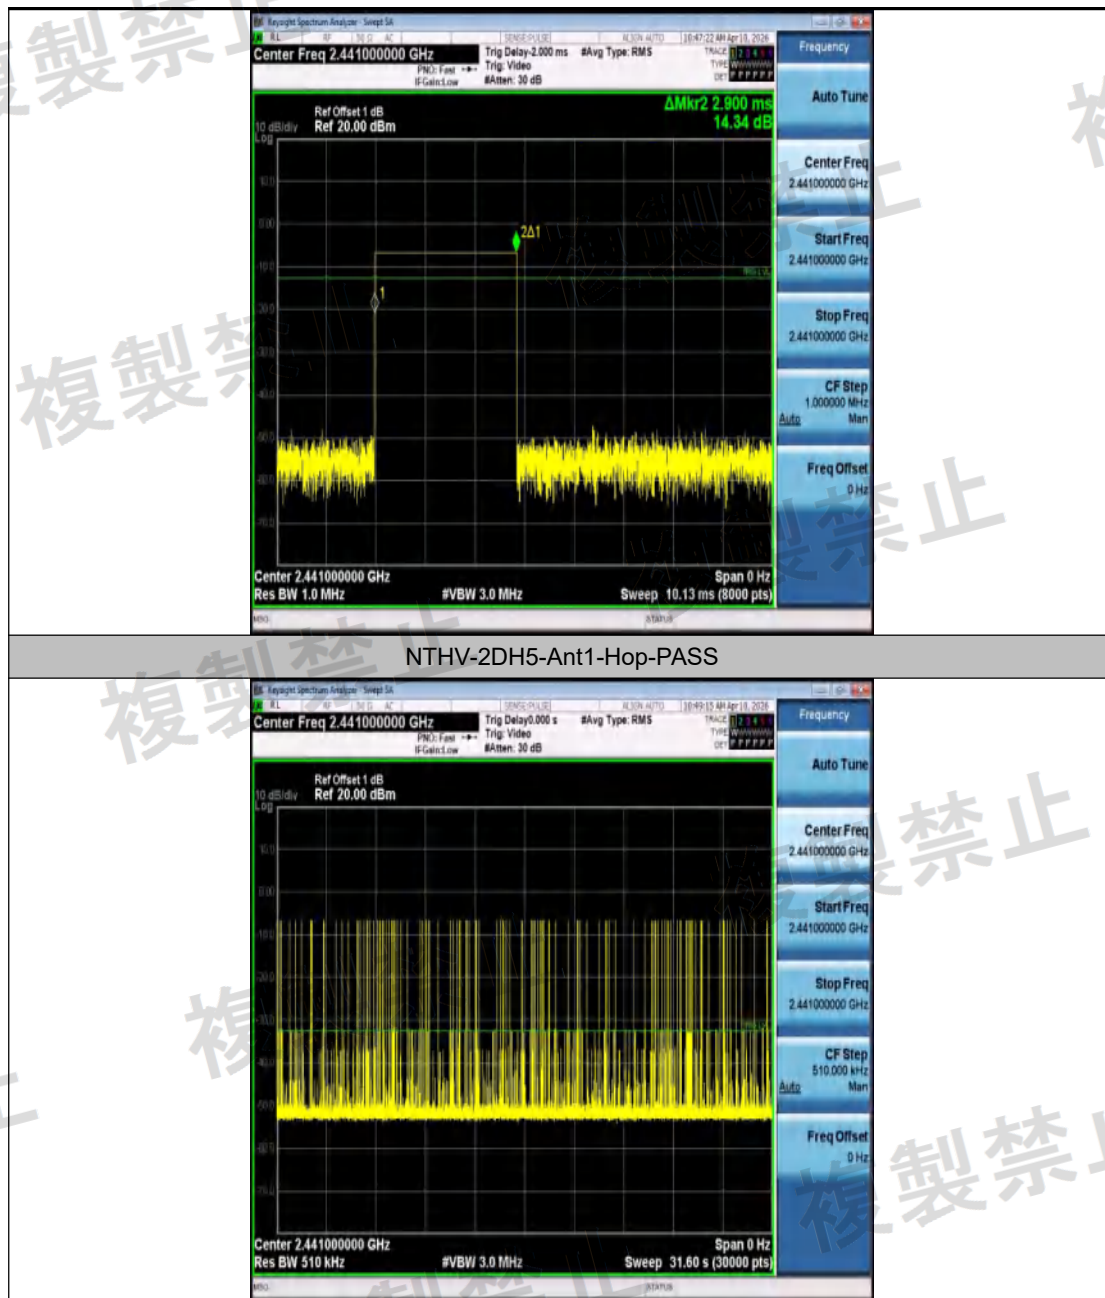

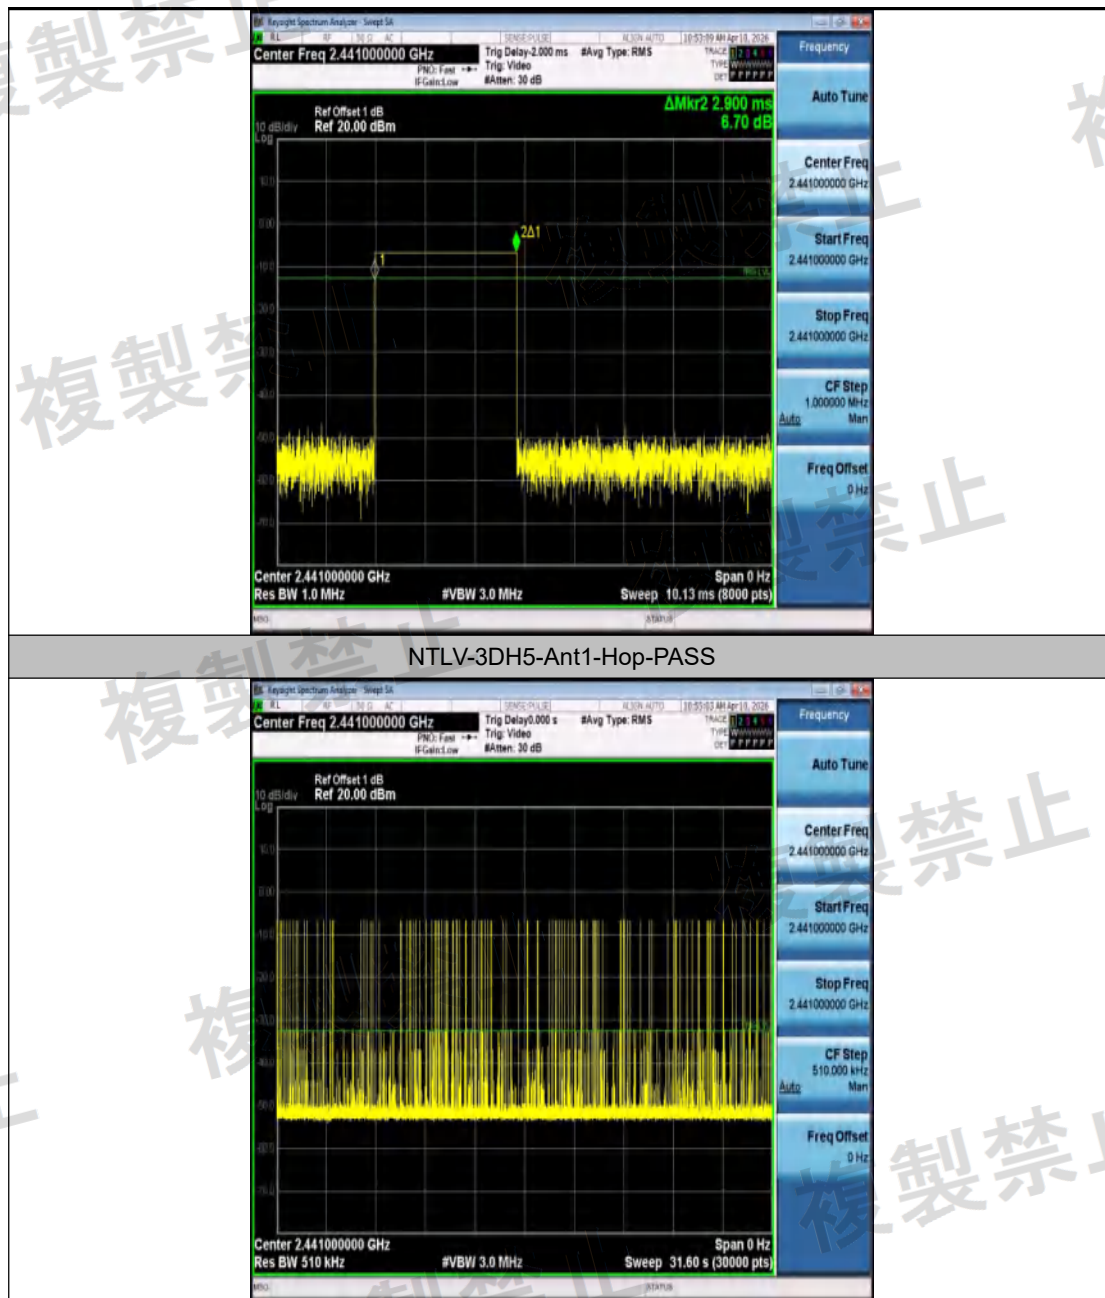

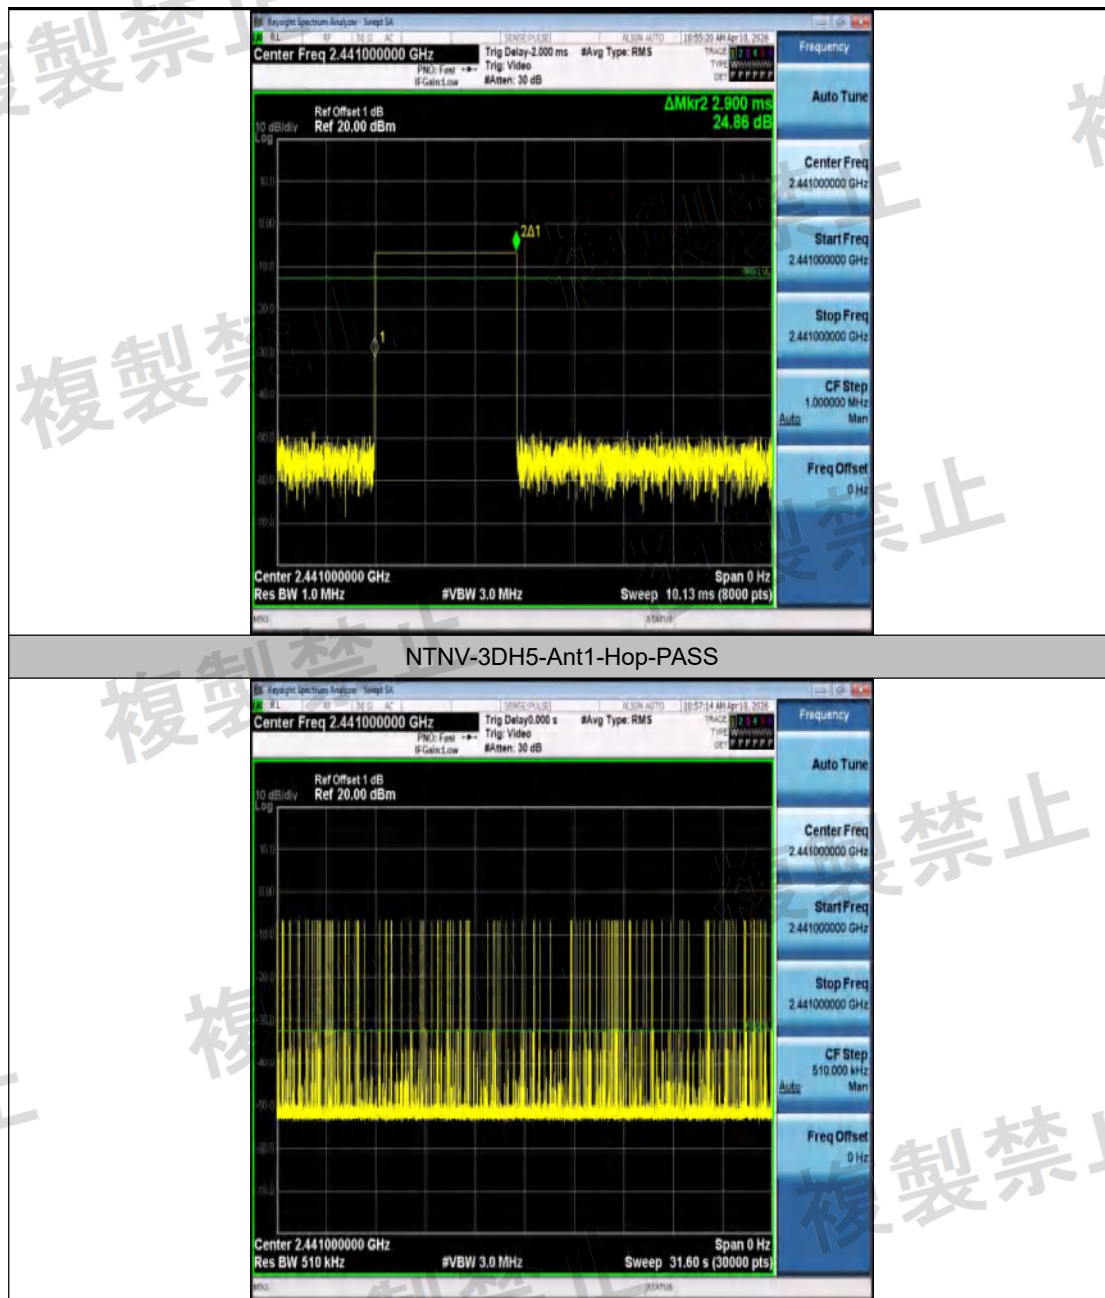

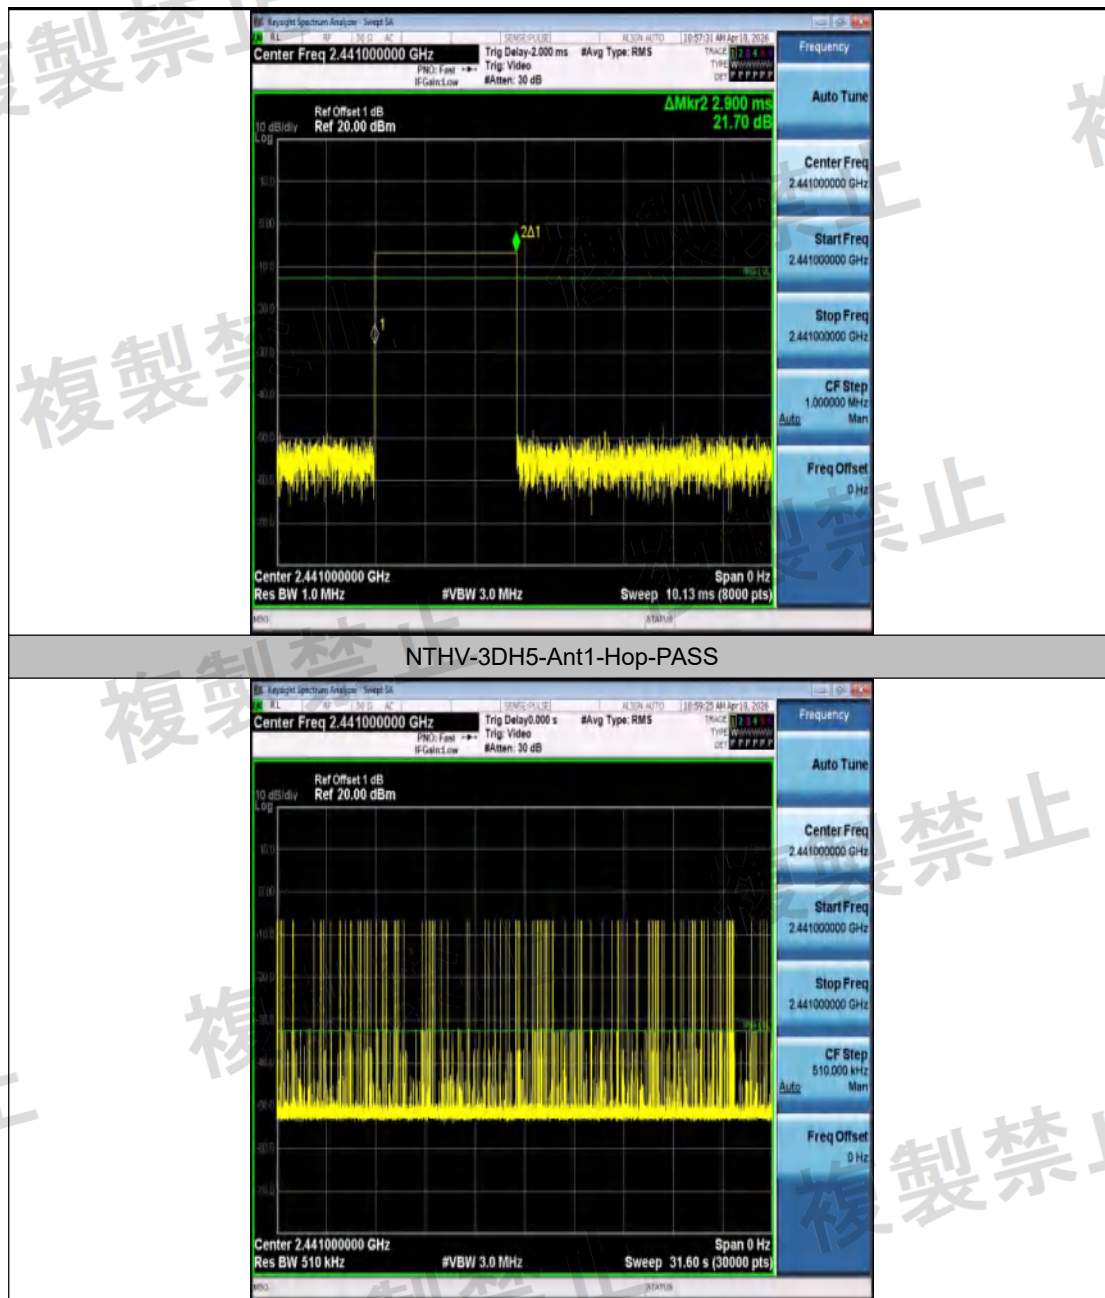

---End---

