

Frequency Tolerance

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5179.956	-44000	-8.49	20	Pass
NVNT	a	5200	Ant1	5199.956	-44000	-8.46	20	Pass
NVNT	a	5240	Ant1	5239.958	-42000	-8.02	20	Pass
NVNT	a	5500	Ant1	5499.954	-46000	-8.36	20	Pass
NVNT	a	5580	Ant1	5579.952	-48000	-8.6	20	Pass
NVNT	a	5700	Ant1	5699.952	-48000	-8.42	20	Pass
NVNT	n40	5190	Ant1	5189.957	-43000	-8.29	20	Pass
NVNT	n40	5230	Ant1	5229.957	-43000	-8.22	20	Pass
NVNT	n20	5260	Ant1	5259.971	-29000	-5.51	20	Pass
NVNT	n20	5300	Ant1	5299.97	-30000	-5.66	20	Pass
NVNT	n20	5320	Ant1	5319.969	-31000	-5.83	20	Pass
NVNT	ac40	5270	Ant1	5269.97	-30000	-5.69	20	Pass
NVNT	ac40	5310	Ant1	5309.969	-31000	-5.84	20	Pass
NVNT	ac40	5510	Ant1	5509.954	-46000	-8.35	20	Pass
NVNT	ac40	5590	Ant1	5589.954	-46000	-8.23	20	Pass
NVNT	ac40	5670	Ant1	5669.954	-46000	-8.11	20	Pass


Test Graphs
Freq. Error NVNT a 5180MHz Ant1

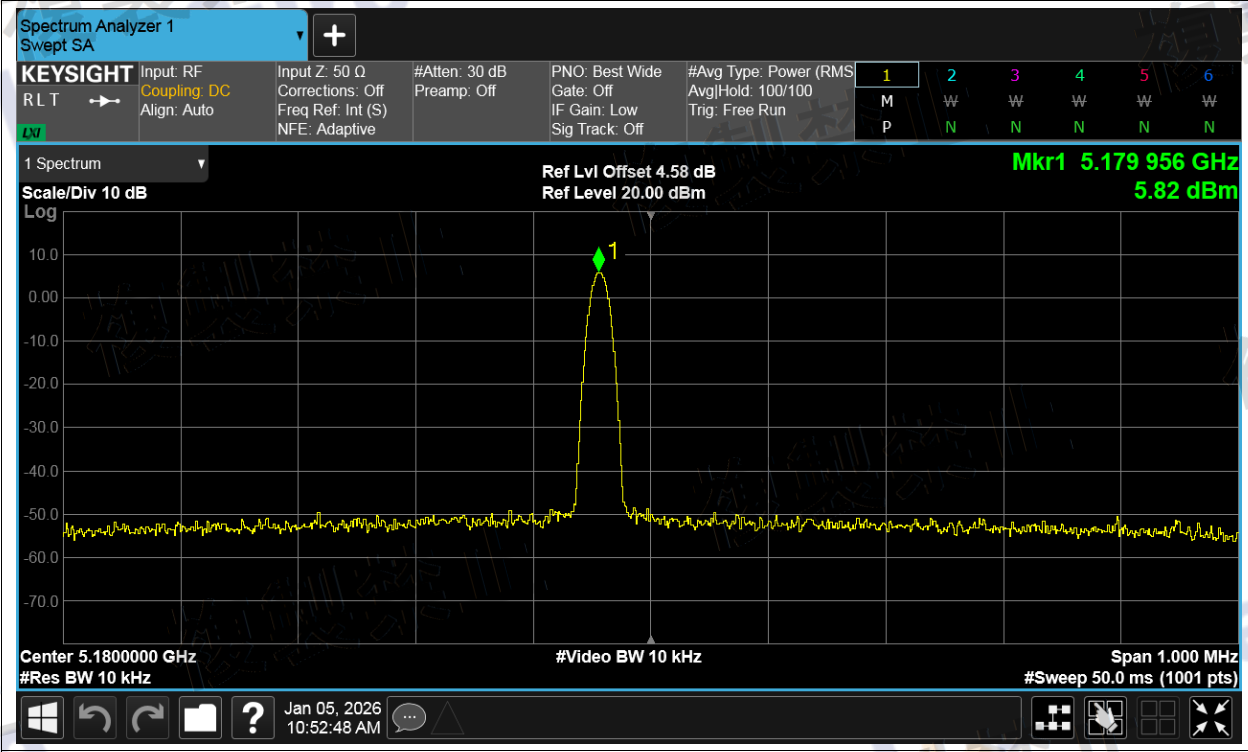


Freq. Error NVNT a 5200MHz Ant1

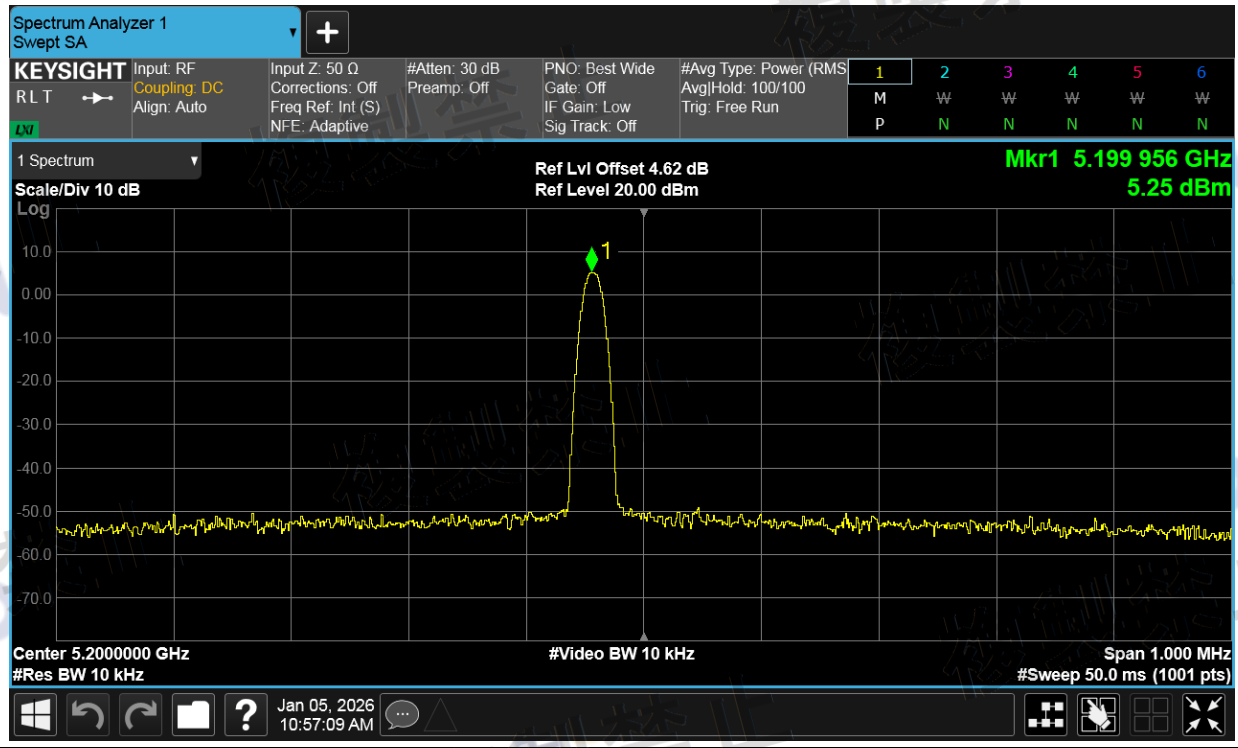


Freq. Error NVNT a 5240MHz Ant1

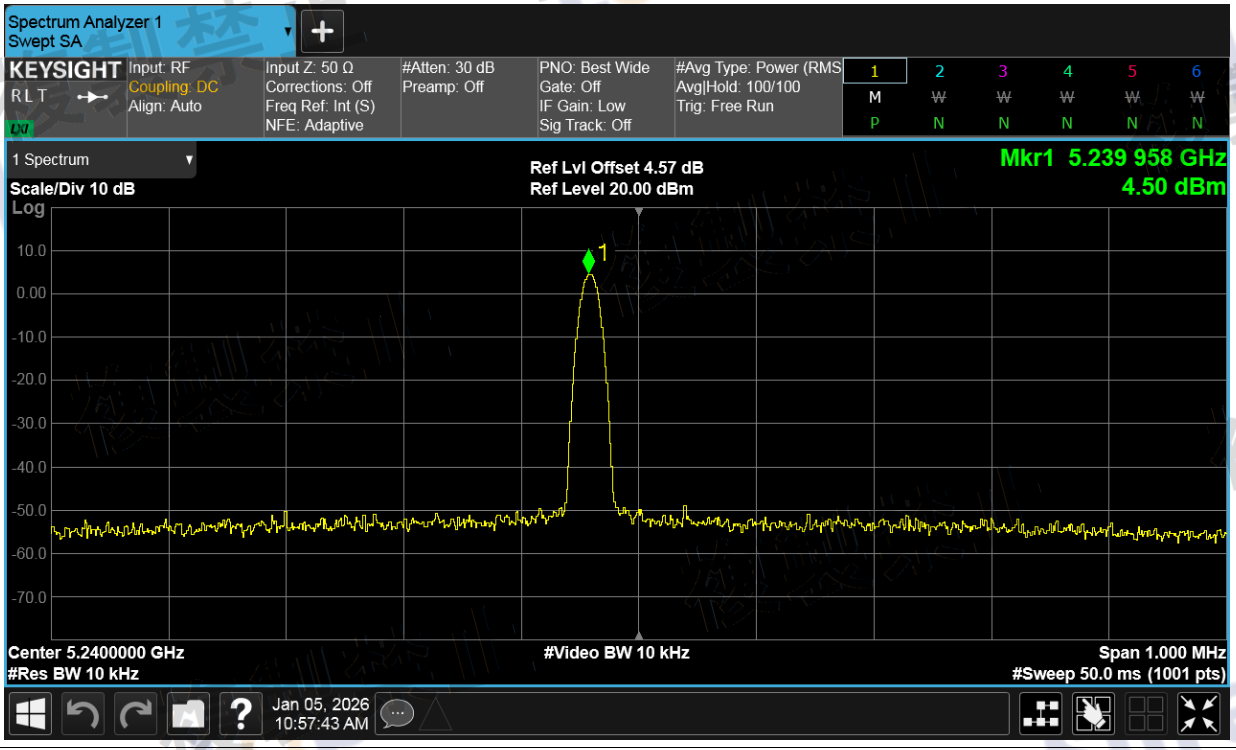


Freq. Error NVNT a 5500MHz Ant1

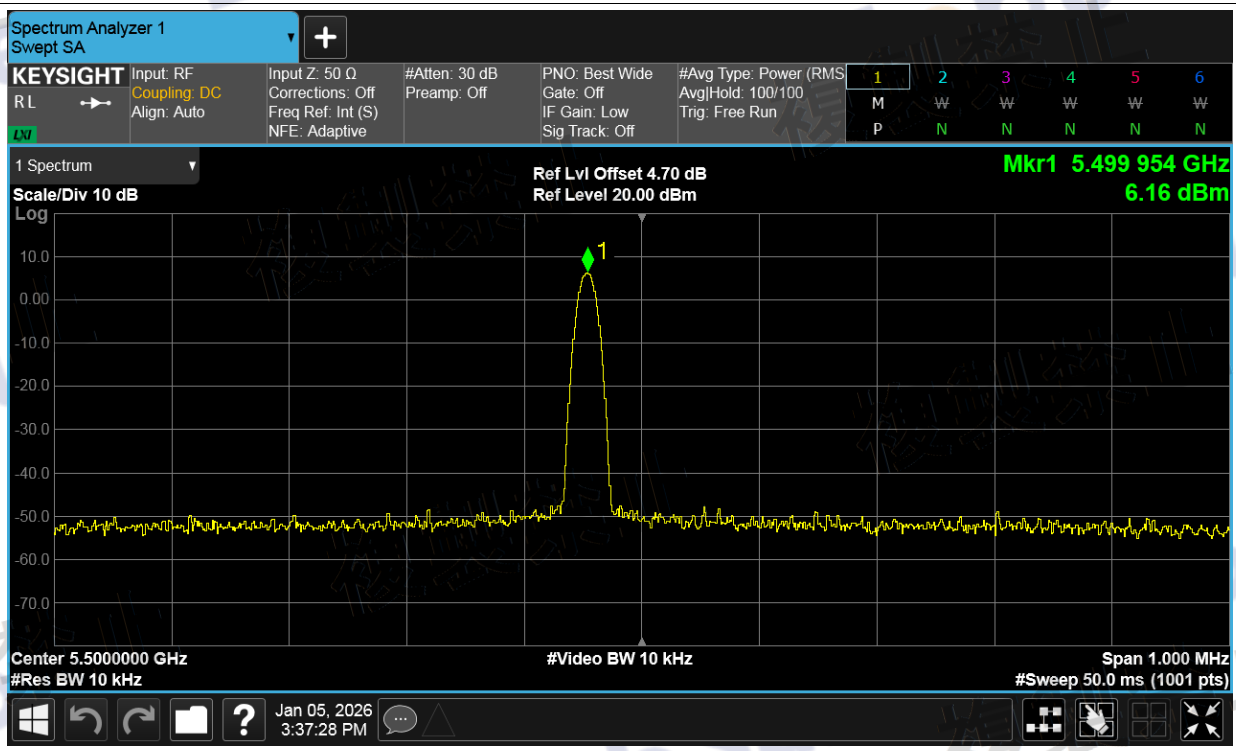


Freq. Error NVNT a 5580MHz Ant1

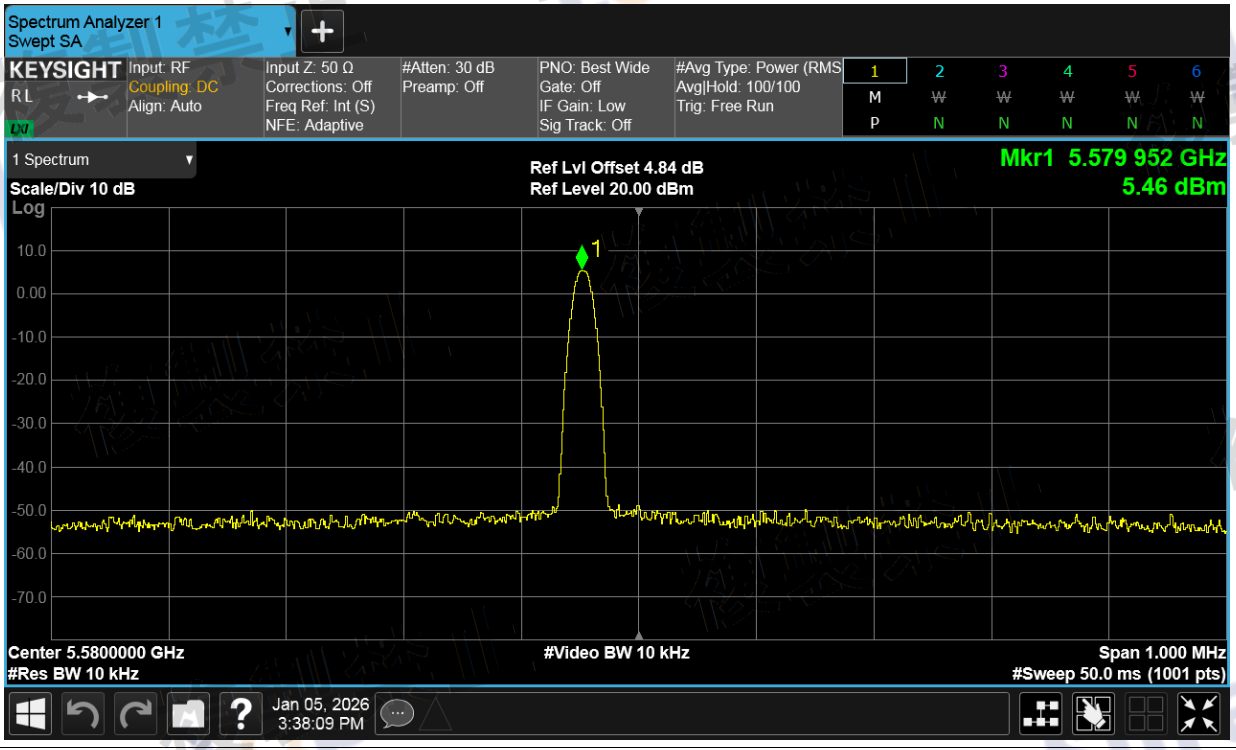


Freq. Error NVNT a 5700MHz Ant1

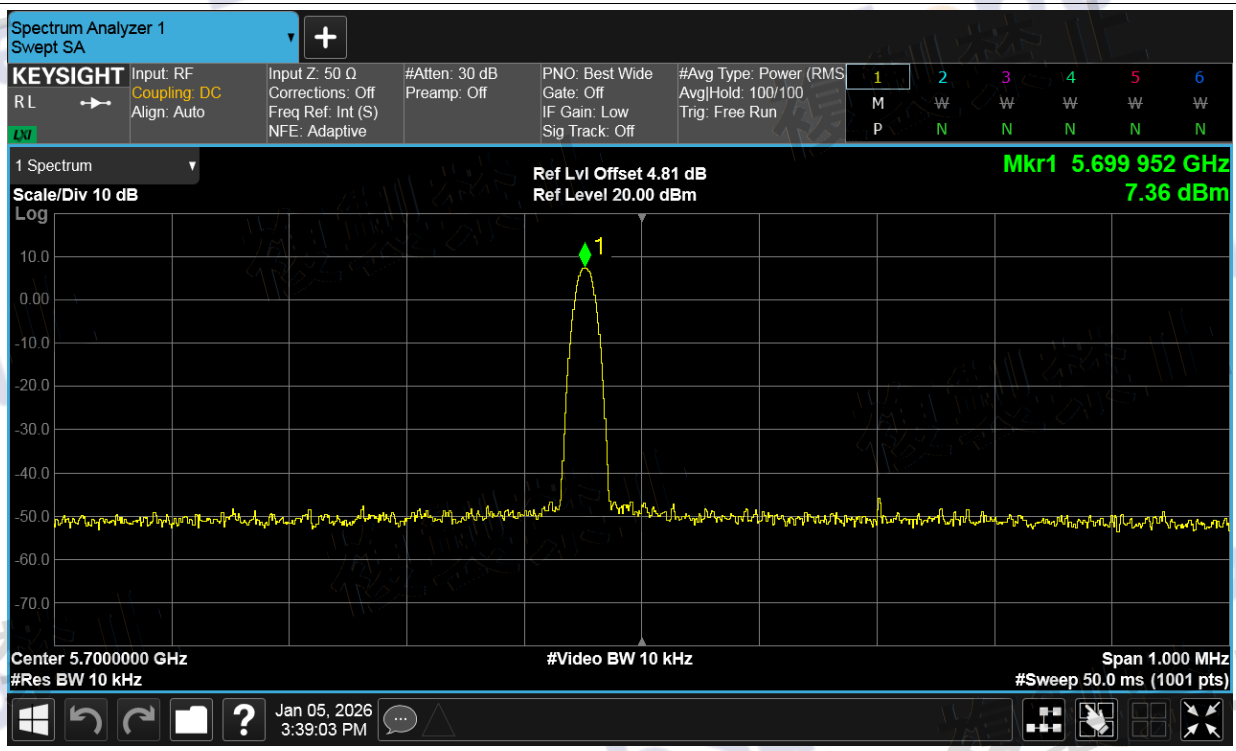


Freq. Error NVNT n40 5190MHz Ant1

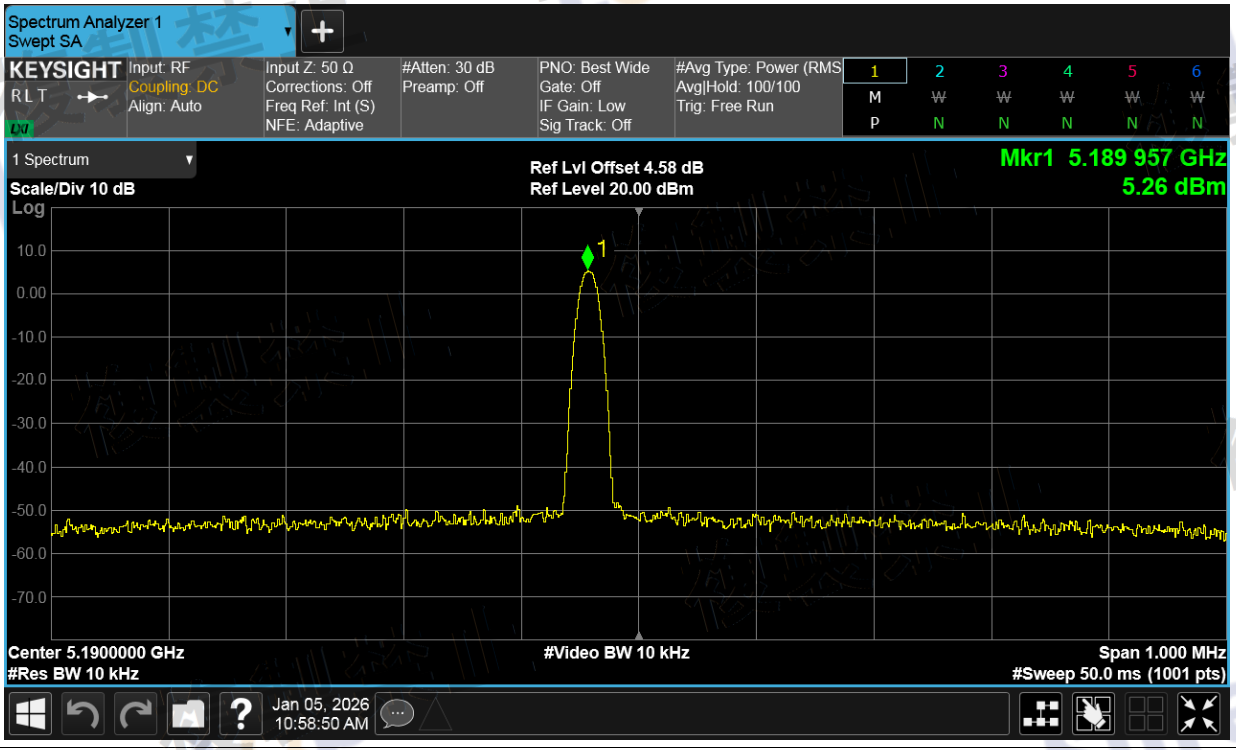


Freq. Error NVNT n40 5230MHz Ant1

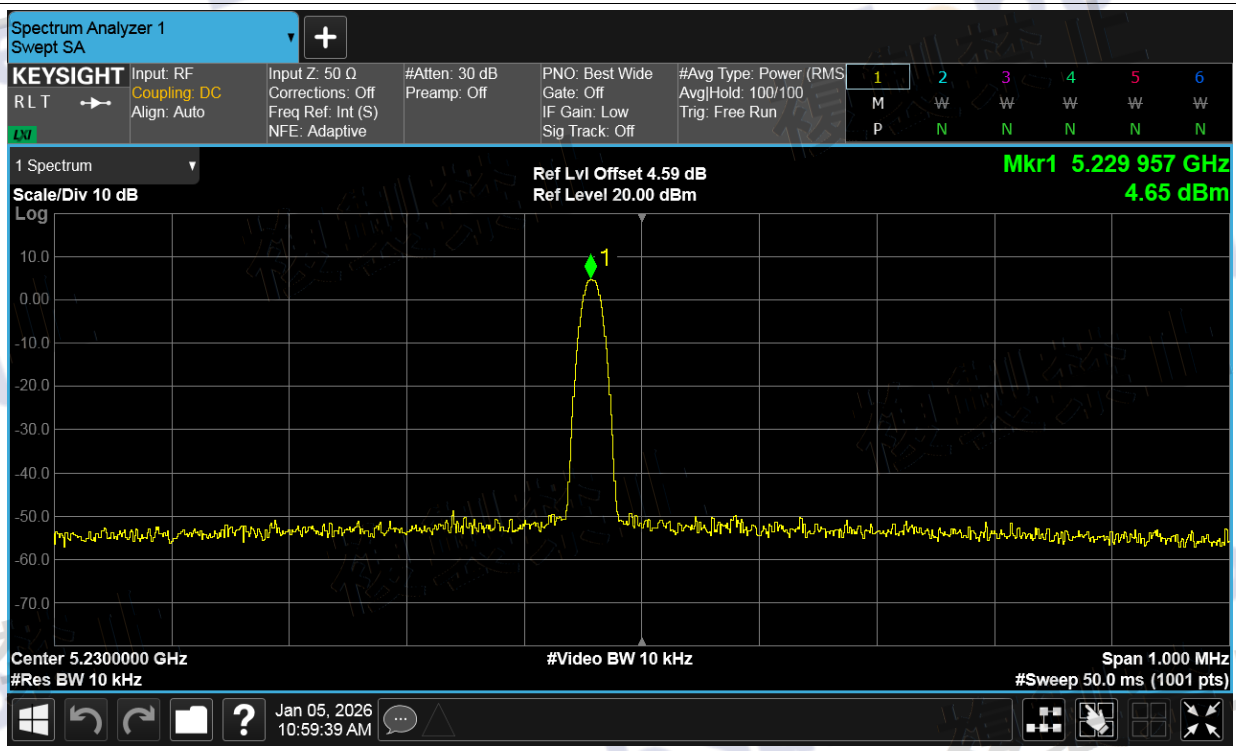


Freq. Error NVNT n20 5260MHz Ant1

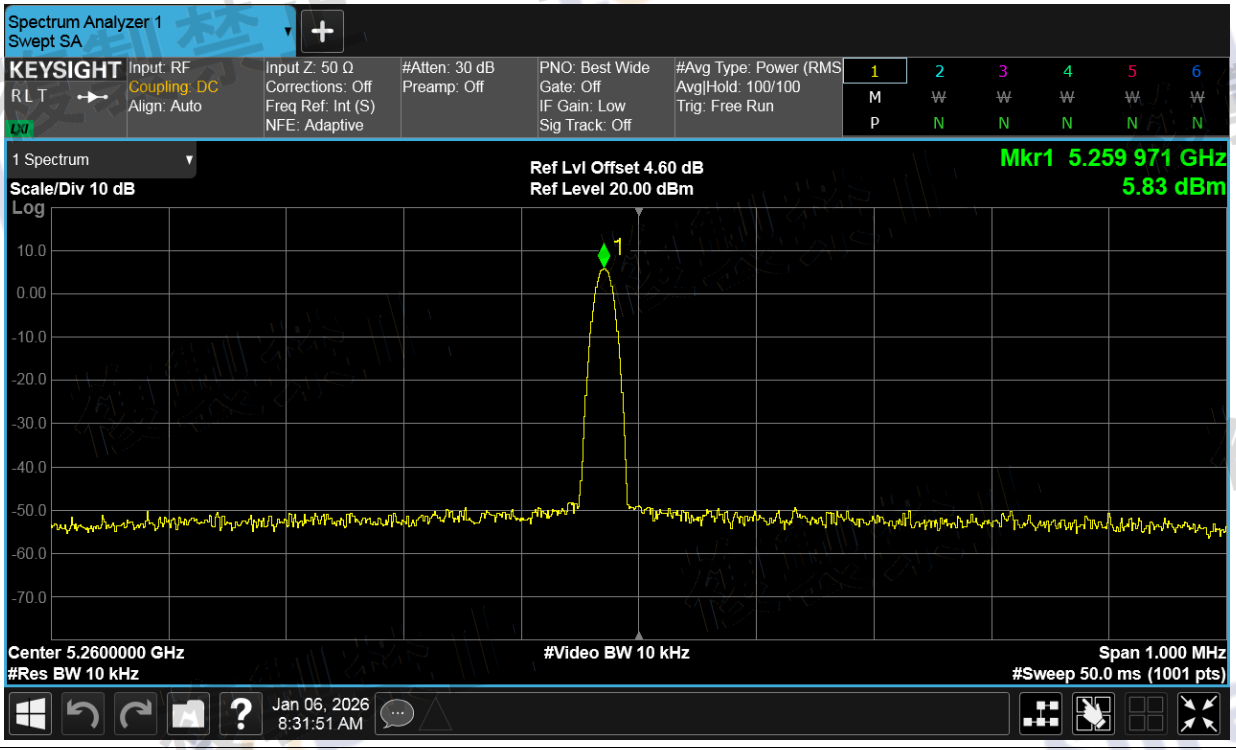


Freq. Error NVNT n20 5300MHz Ant1

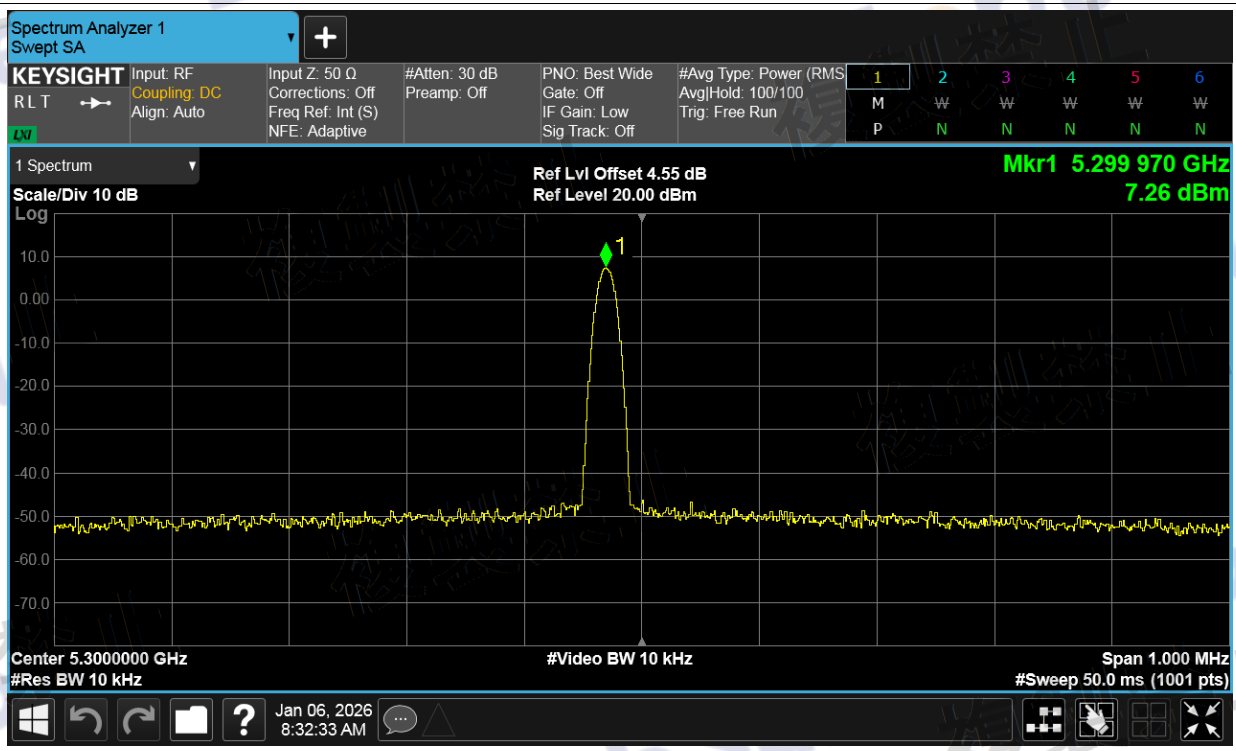


Freq. Error NVNT n20 5320MHz Ant1

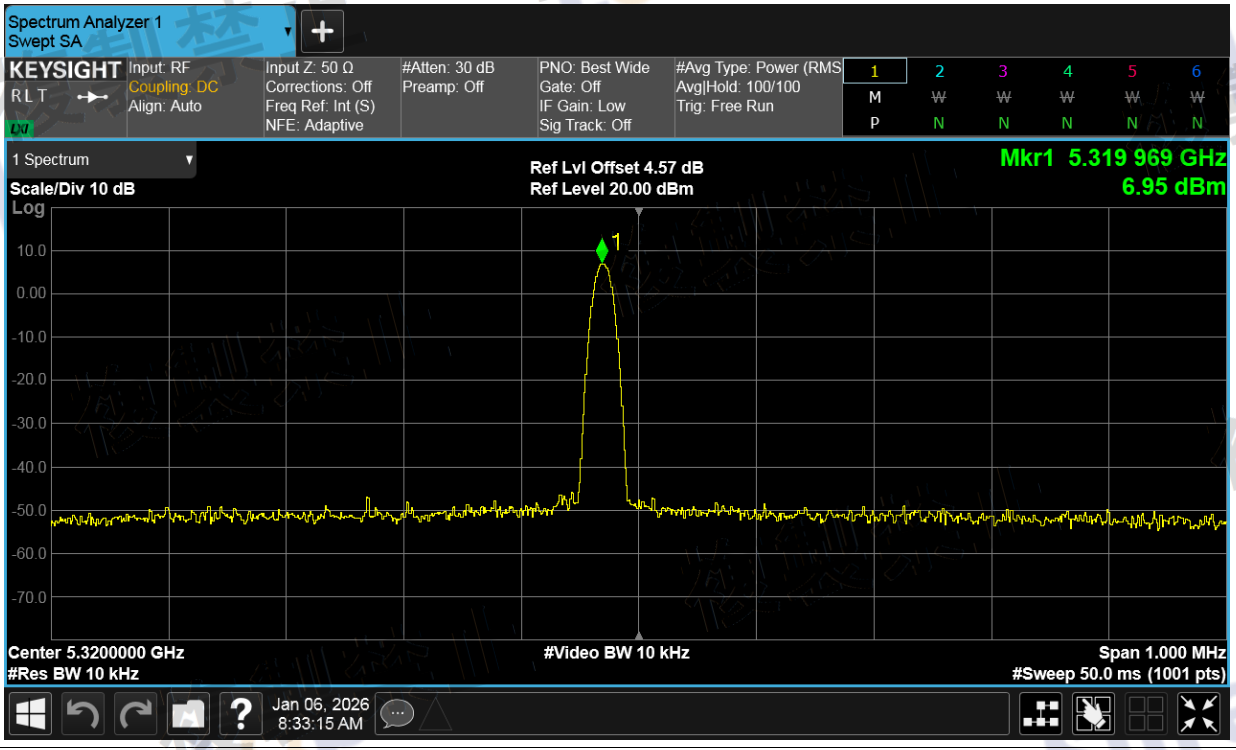


Freq. Error NVNT ac40 5270MHz Ant1

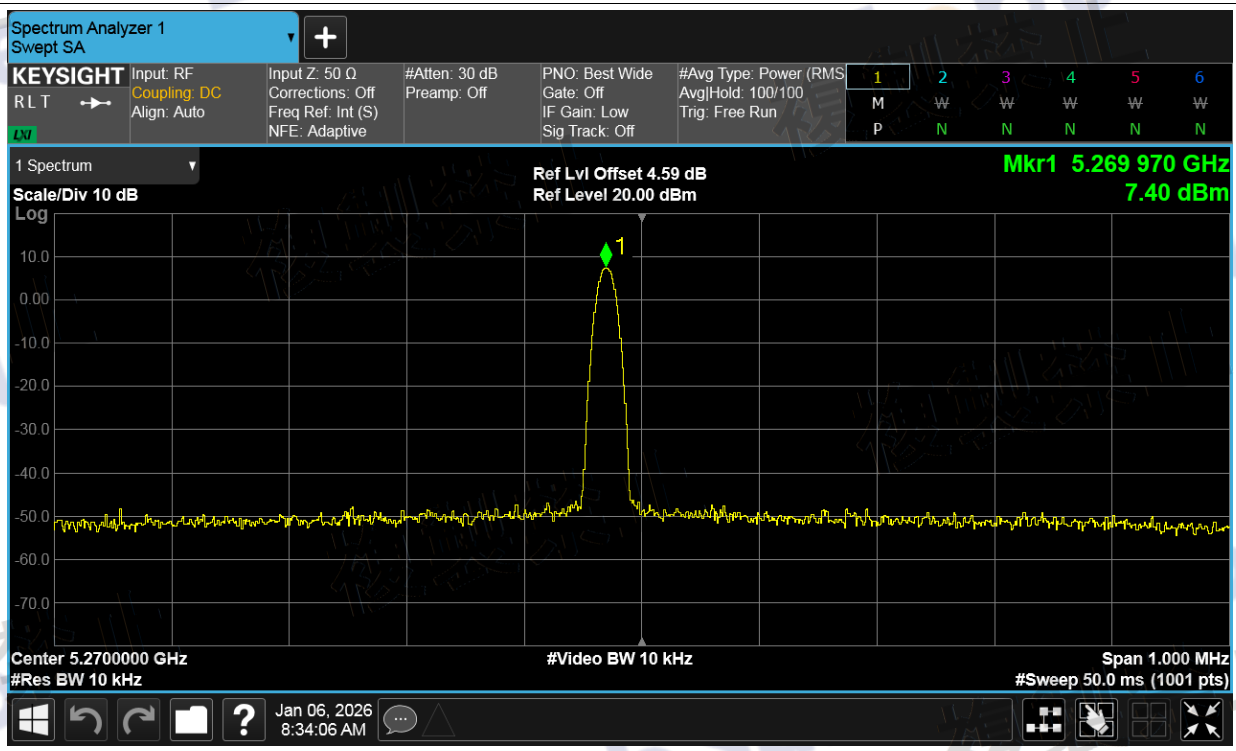


Freq. Error NVNT ac40 5310MHz Ant1

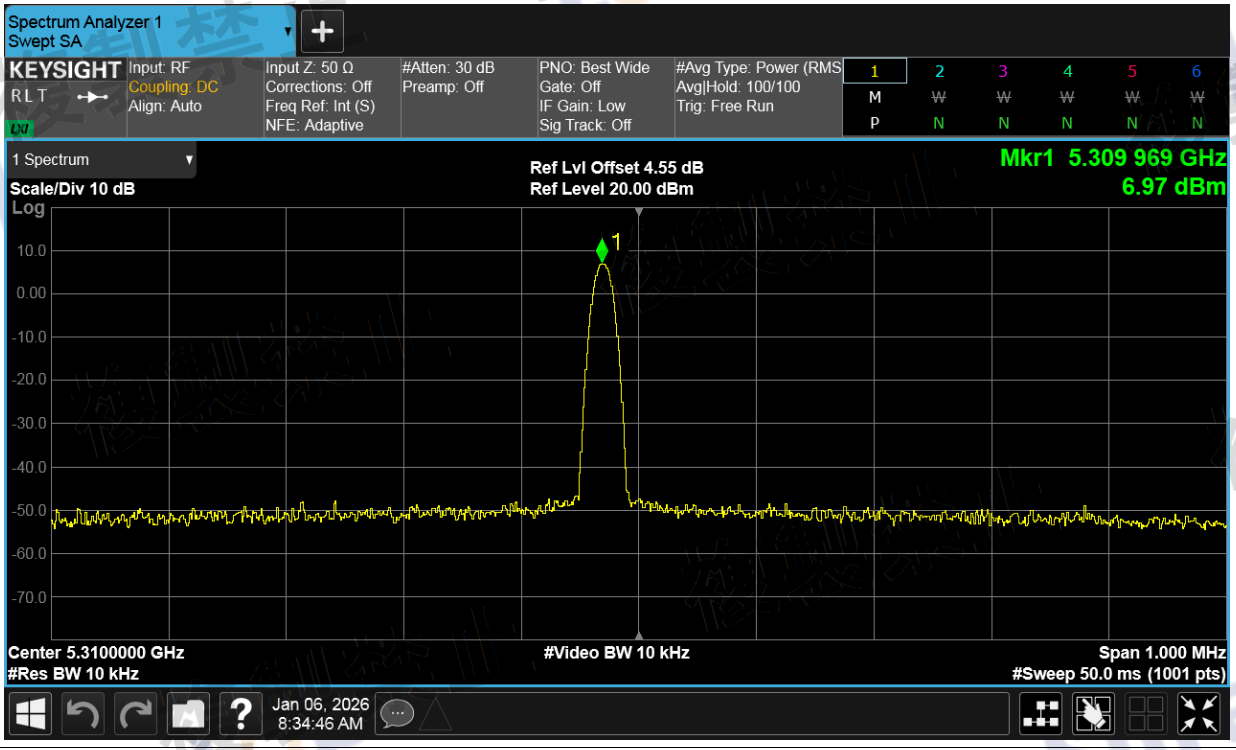


Freq. Error NVNT ac40 5510MHz Ant1

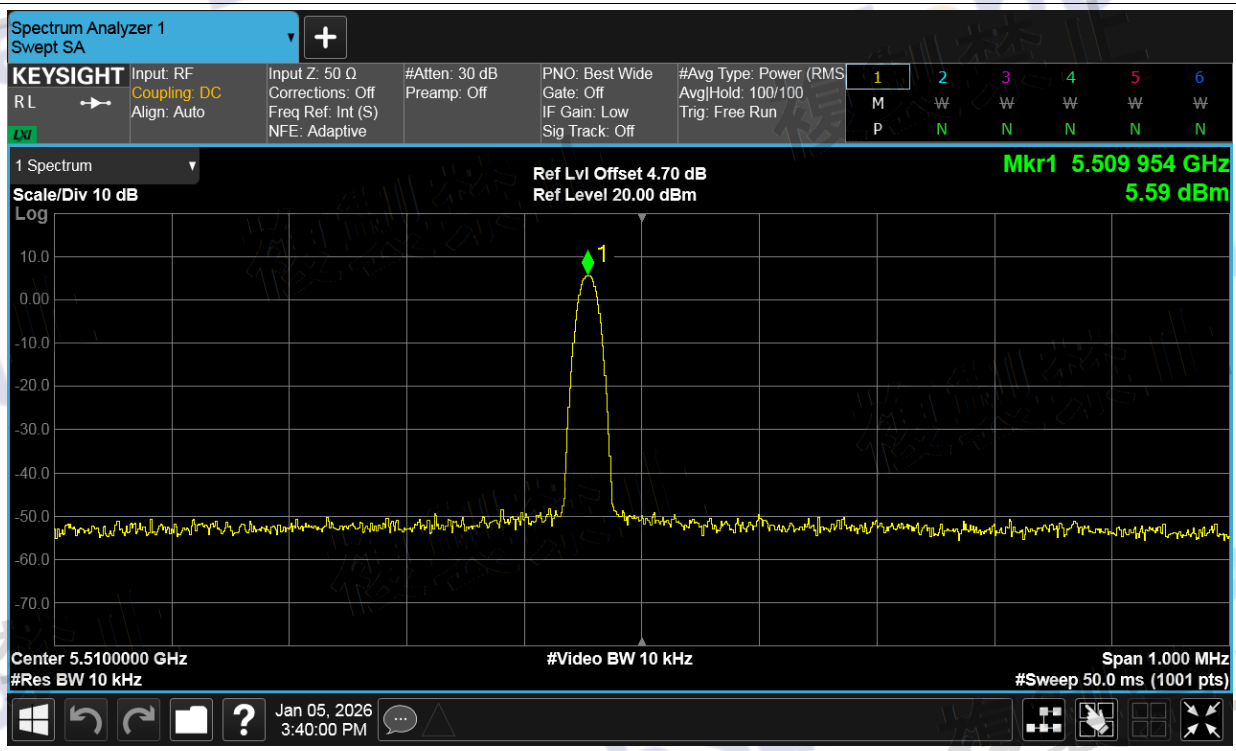

Freq. Error NVNT ac40 5590MHz Ant1

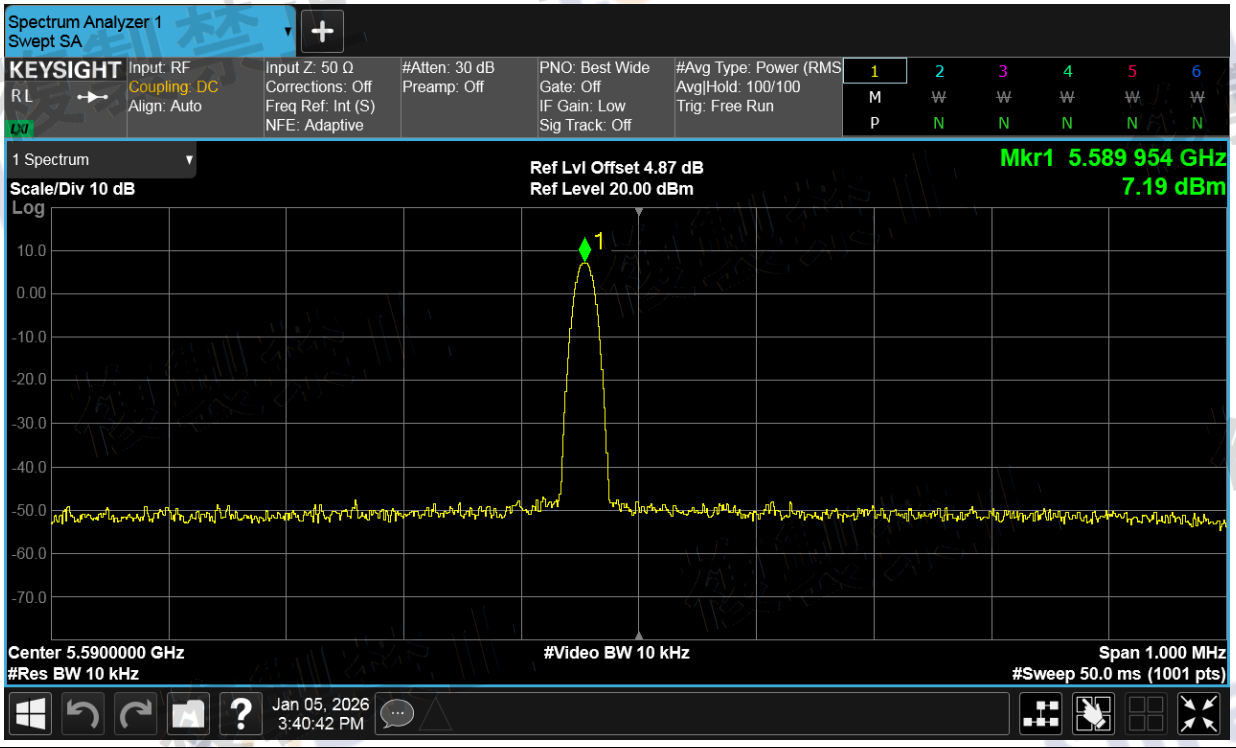

Freq. Error NVNT ac40 5670MHz Ant1

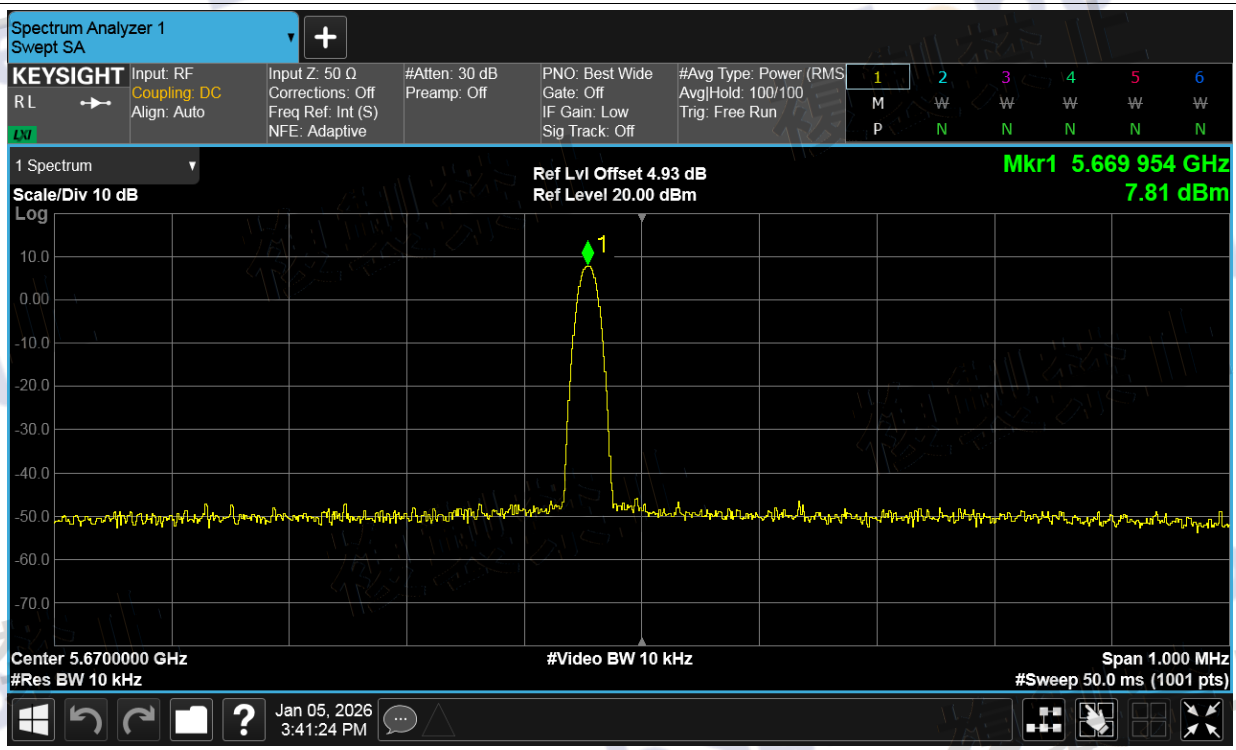


Antenna Power and Tolerances for Antenna Power


Condition	Mode	Frequency (MHz)	Antenna	Power (dBm/MHz)	Antenna Power (mW/MHz)	Limit (mW/MHz)	Declared Power (mW/MHz)	Tolerance (%)	Upper Limit (%)	Lower Limit (%)	Verdict
NVNT	a	5180	Ant1	1.75	1.50	10	2	-25.00	20	-80	Pass
NVNT	a	5200	Ant1	1.41	1.38	10	2	-31.00	20	-80	Pass
NVNT	a	5240	Ant1	1.94	1.56	10	2	-22.00	20	-80	Pass
NVNT	a	5260	Ant1	-0.13	0.97	10	1.5	-35.33	20	-80	Pass
NVNT	a	5300	Ant1	1.38	1.37	10	1.5	-8.67	20	-80	Pass
NVNT	a	5320	Ant1	1.22	1.32	10	1.5	-12.00	20	-80	Pass
NVNT	a	5500	Ant1	-1.03	0.79	10	1	-21.00	50	-50	Pass
NVNT	a	5580	Ant1	-1.29	0.74	10	1	-26.00	50	-50	Pass
NVNT	a	5700	Ant1	-0.13	0.97	10	1	-3.00	50	-50	Pass
NVNT	n20	5180	Ant1	1.45	1.40	10	2	-30.00	20	-80	Pass
NVNT	n20	5200	Ant1	1.06	1.28	10	2	-36.00	20	-80	Pass
NVNT	n20	5240	Ant1	1.57	1.44	10	2	-28.00	20	-80	Pass
NVNT	n20	5260	Ant1	-0.14	0.97	10	1.5	-35.33	20	-80	Pass
NVNT	n20	5300	Ant1	1.35	1.36	10	1.5	-9.33	20	-80	Pass
NVNT	n20	5320	Ant1	1.09	1.29	10	1.5	-14.00	20	-80	Pass
NVNT	n20	5500	Ant1	-1.31	0.74	10	1	-26.00	50	-50	Pass
NVNT	n20	5580	Ant1	-1.58	0.69	10	1	-31.00	50	-50	Pass
NVNT	n20	5700	Ant1	-0.33	0.93	10	1	-7.00	50	-50	Pass
NVNT	n40	5190	Ant1	-1.14	0.77	5	1	-23.00	20	-80	Pass
NVNT	n40	5200	Ant1	-1.34	0.74	5	1	-26.00	20	-80	Pass
NVNT	n40	5230	Ant1	-0.82	0.83	5	1	-17.00	20	-80	Pass
NVNT	n40	5270	Ant1	-2.56	0.55	5	1	-45.00	20	-80	Pass
NVNT	n40	5310	Ant1	-2.59	0.55	5	1	-45.00	20	-80	Pass
NVNT	n40	5510	Ant1	-5.23	0.30	5	0.4	-25.00	50	-50	Pass
NVNT	n40	5590	Ant1	-3.31	0.47	5	0.4	17.50	50	-50	Pass
NVNT	n40	5670	Ant1	-2.77	0.53	5	0.4	32.50	50	-50	Pass
NVNT	ac20	5180	Ant1	1.08	1.28	10	1.5	-14.67	20	-80	Pass
NVNT	ac20	5200	Ant1	0.82	1.21	10	1.5	-19.33	20	-80	Pass
NVNT	ac20	5240	Ant1	1.30	1.35	10	1.5	-10.00	20	-80	Pass
NVNT	ac20	5260	Ant1	1.54	1.43	10	2	-28.50	20	-80	Pass
NVNT	ac20	5300	Ant1	2.42	1.75	10	2	-12.50	20	-80	Pass
NVNT	ac20	5320	Ant1	2.01	1.59	10	2	-20.50	20	-80	Pass
NVNT	ac20	5500	Ant1	-1.53	0.70	10	1	-30.00	50	-50	Pass
NVNT	ac20	5580	Ant1	-1.71	0.68	10	1	-32.00	50	-50	Pass
NVNT	ac20	5700	Ant1	-0.52	0.89	10	1	-11.00	50	-50	Pass
NVNT	ac40	5190	Ant1	-1.86	0.65	5	1	-35.00	20	-80	Pass
NVNT	ac40	5200	Ant1	-2.15	0.61	5	1	-39.00	20	-80	Pass
NVNT	ac40	5230	Ant1	-1.62	0.69	5	1	-31.00	20	-80	Pass
NVNT	ac40	5270	Ant1	-0.76	0.84	5	1	-16.00	20	-80	Pass

NVNT	ac40	5310	Ant1	-0.98	0.80	5	1	-20.00	20	-80	Pass
NVNT	ac40	5510	Ant1	-6.10	0.25	5	0.4	-37.50	50	-50	Pass
NVNT	ac40	5590	Ant1	-4.12	0.39	5	0.4	-2.50	50	-50	Pass
NVNT	ac40	5670	Ant1	-3.83	0.41	5	0.4	2.50	50	-50	Pass
NVNT	ax20	5180	Ant1	0.76	1.19	10	1.5	-20.67	20	-80	Pass
NVNT	ax20	5200	Ant1	0.34	1.08	10	1.5	-28.00	20	-80	Pass
NVNT	ax20	5240	Ant1	0.45	1.11	10	1.5	-26.00	20	-80	Pass
NVNT	ax20	5260	Ant1	-0.60	0.87	10	1.5	-42.00	20	-80	Pass
NVNT	ax20	5300	Ant1	0.75	1.19	10	1.5	-20.67	20	-80	Pass
NVNT	ax20	5320	Ant1	0.41	1.10	10	1.5	-26.67	20	-80	Pass
NVNT	ax20	5500	Ant1	-1.96	0.64	10	1	-36.00	50	-50	Pass
NVNT	ax20	5580	Ant1	-2.18	0.60	10	1	-40.00	50	-50	Pass
NVNT	ax20	5700	Ant1	-0.98	0.80	10	1	-20.00	50	-50	Pass
NVNT	ax40	5190	Ant1	-2.87	0.52	5	1	-48.00	20	-80	Pass
NVNT	ax40	5200	Ant1	-2.87	0.52	5	1	-48.00	20	-80	Pass
NVNT	ax40	5230	Ant1	-2.12	0.61	5	1	-39.00	20	-80	Pass
NVNT	ax40	5270	Ant1	-1.65	0.68	5	1	-32.00	20	-80	Pass
NVNT	ax40	5310	Ant1	-1.63	0.69	5	1	-31.00	20	-80	Pass
NVNT	ax40	5510	Ant1	-6.77	0.21	5	0.4	-47.50	50	-50	Pass
NVNT	ax40	5590	Ant1	-4.93	0.32	5	0.4	-20.00	50	-50	Pass
NVNT	ax40	5670	Ant1	-3.18	0.48	5	0.4	20.00	50	-50	Pass


Test Graphs
Power NVNT a 5180MHz Ant1 Pre Scan

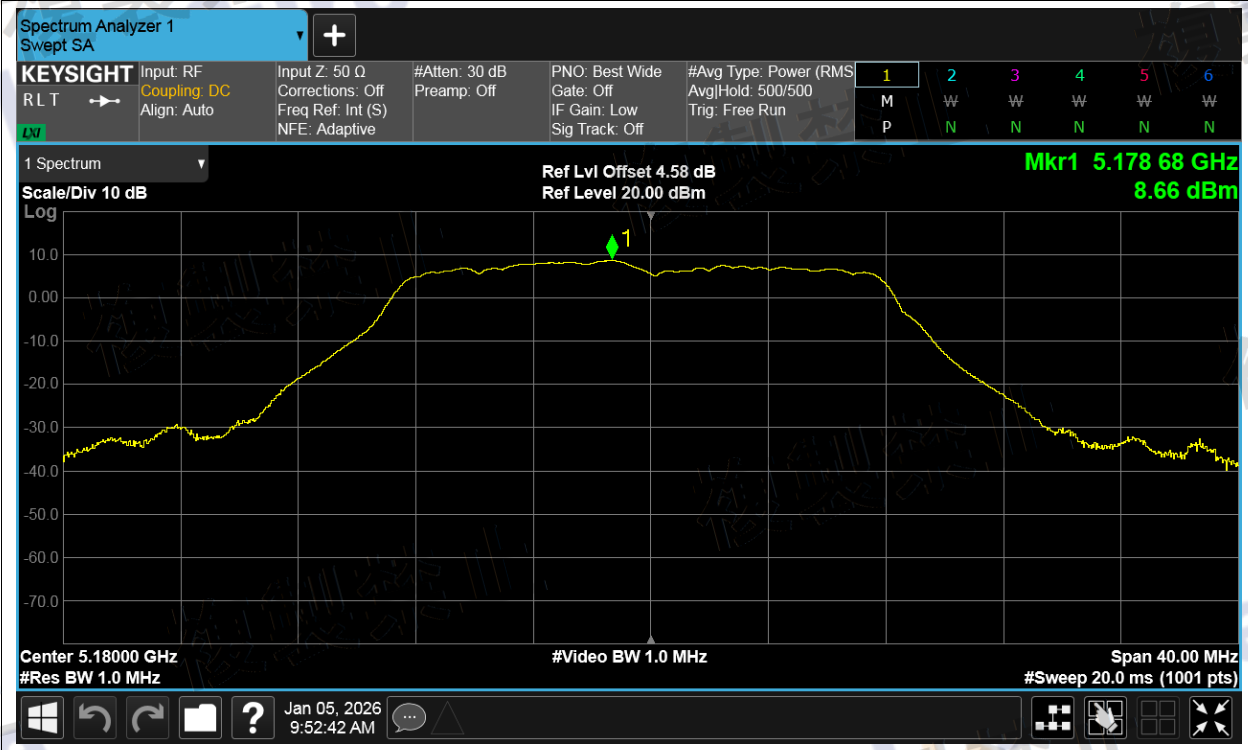


Power NVNT a 5180MHz Ant1 Zero Span

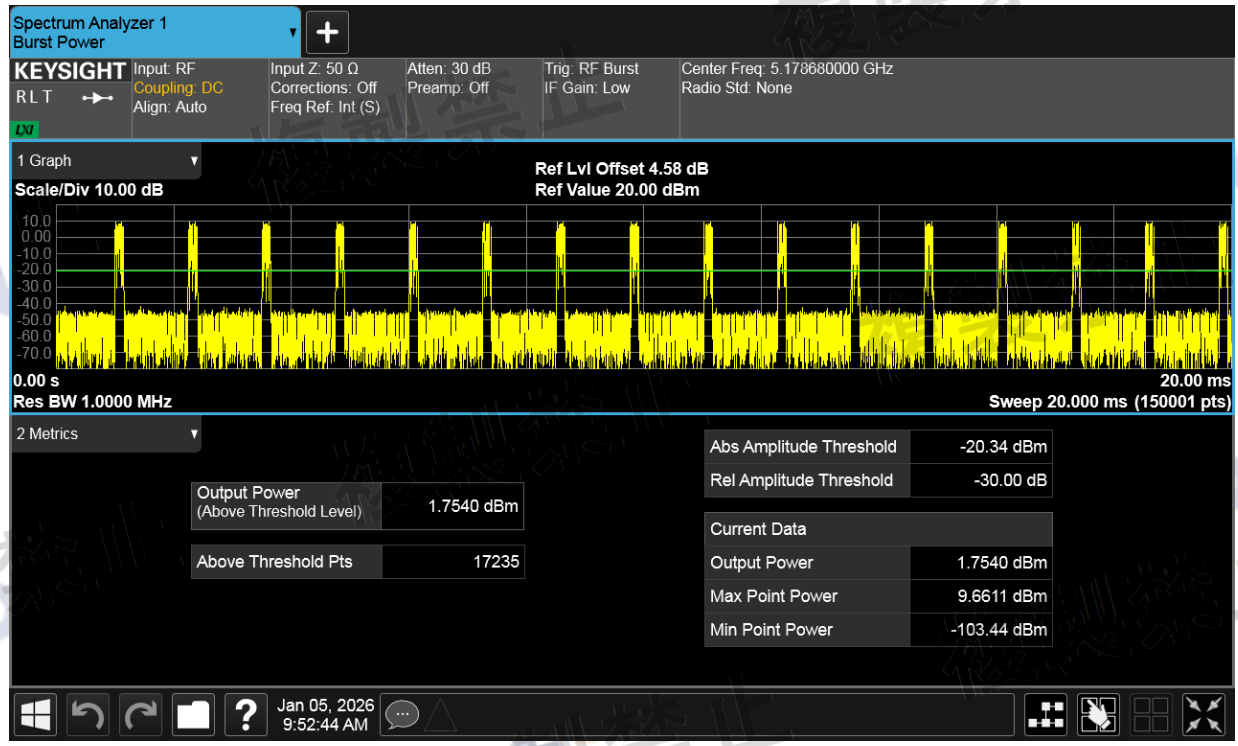


Power NVNT a 5200MHz Ant1 Pre Scan

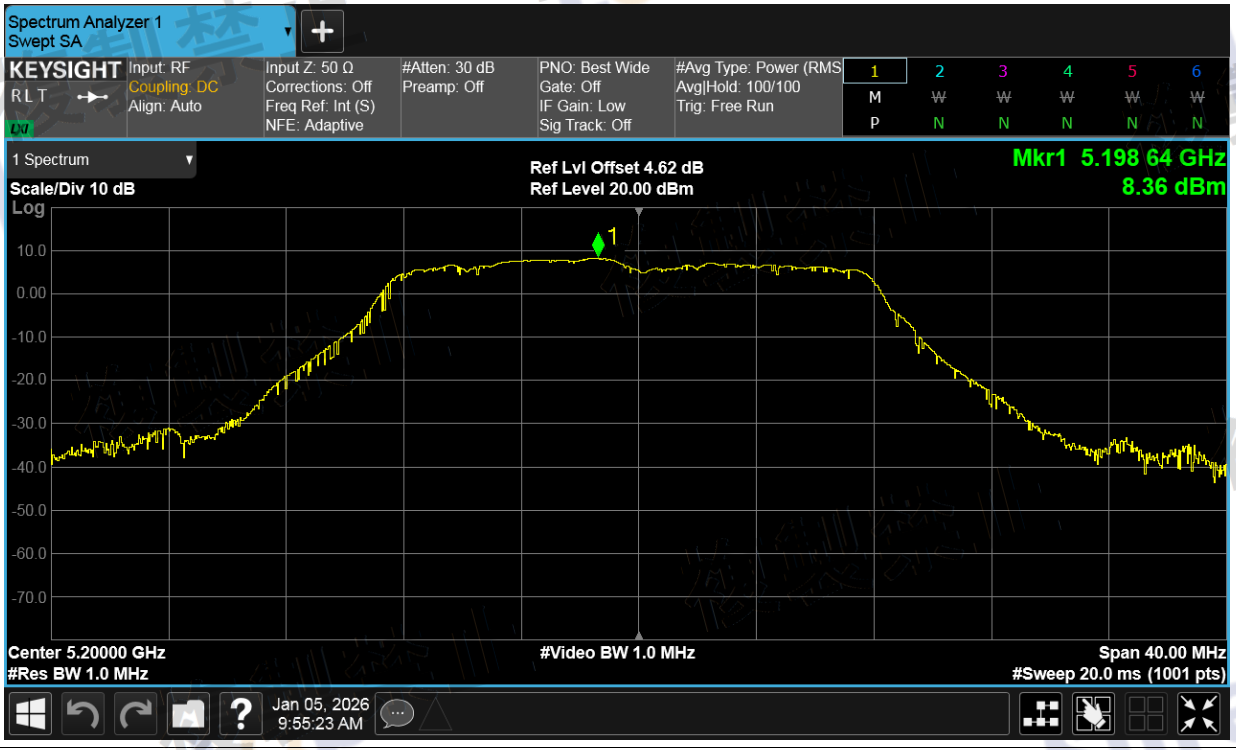


Power NVNT a 5200MHz Ant1 Zero Span

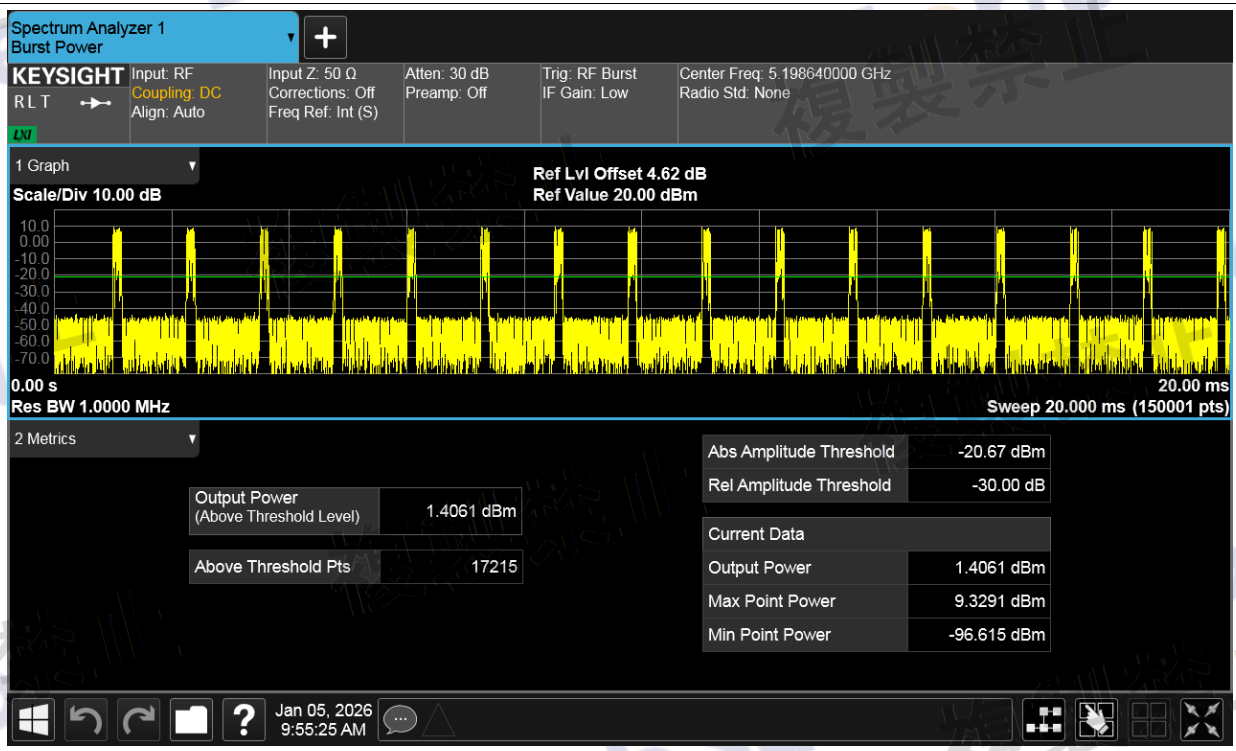


Power NVNT a 5240MHz Ant1 Pre Scan

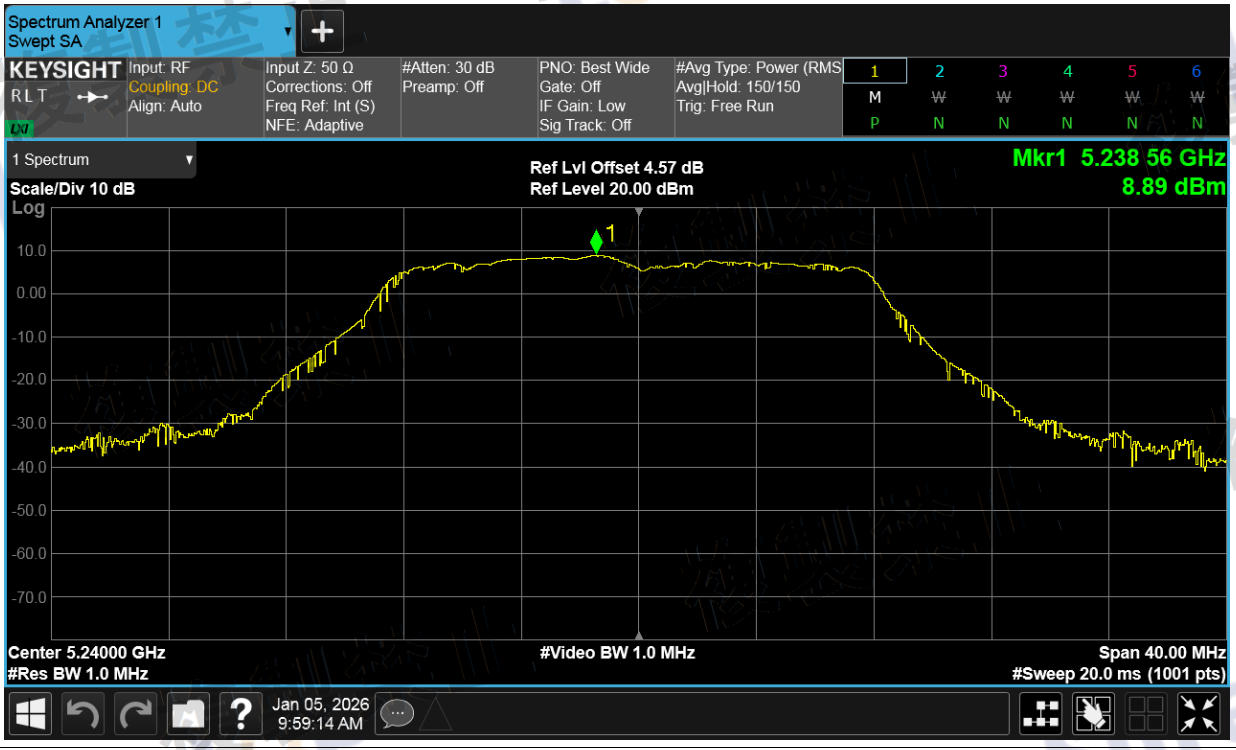


Power NVNT a 5240MHz Ant1 Zero Span

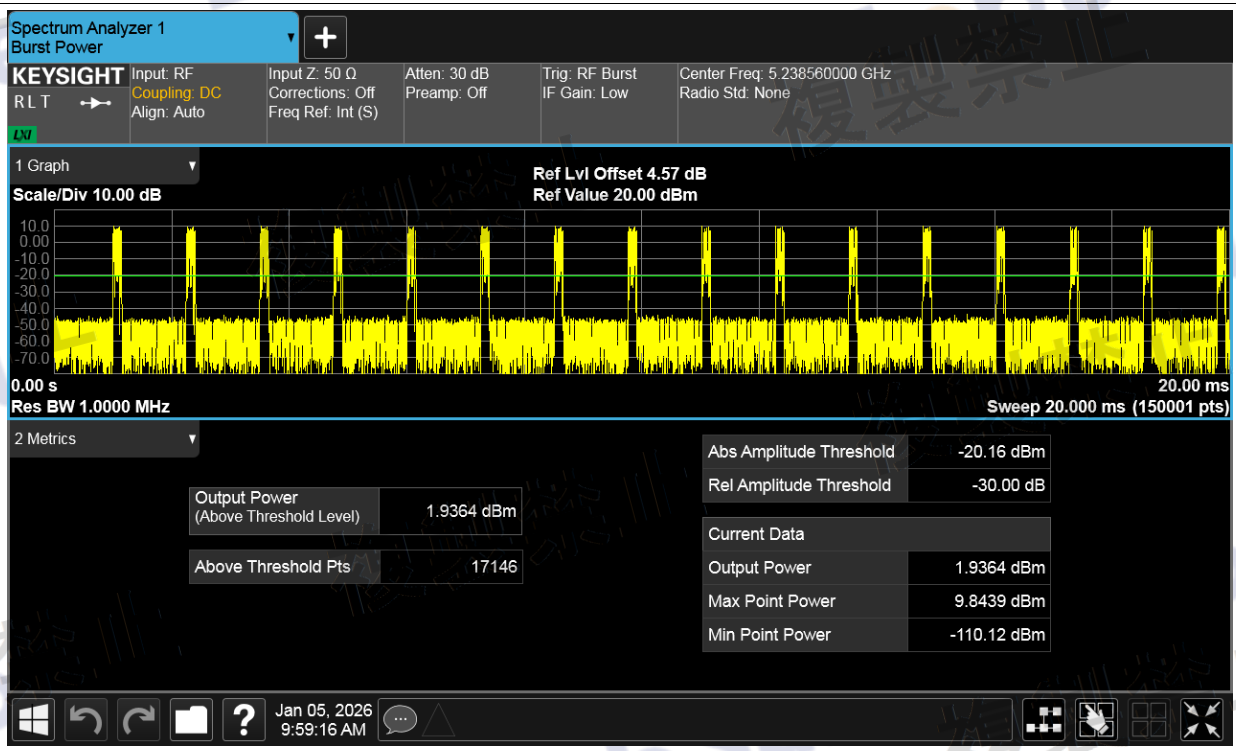


Power NVNT a 5260MHz Ant1 Pre Scan

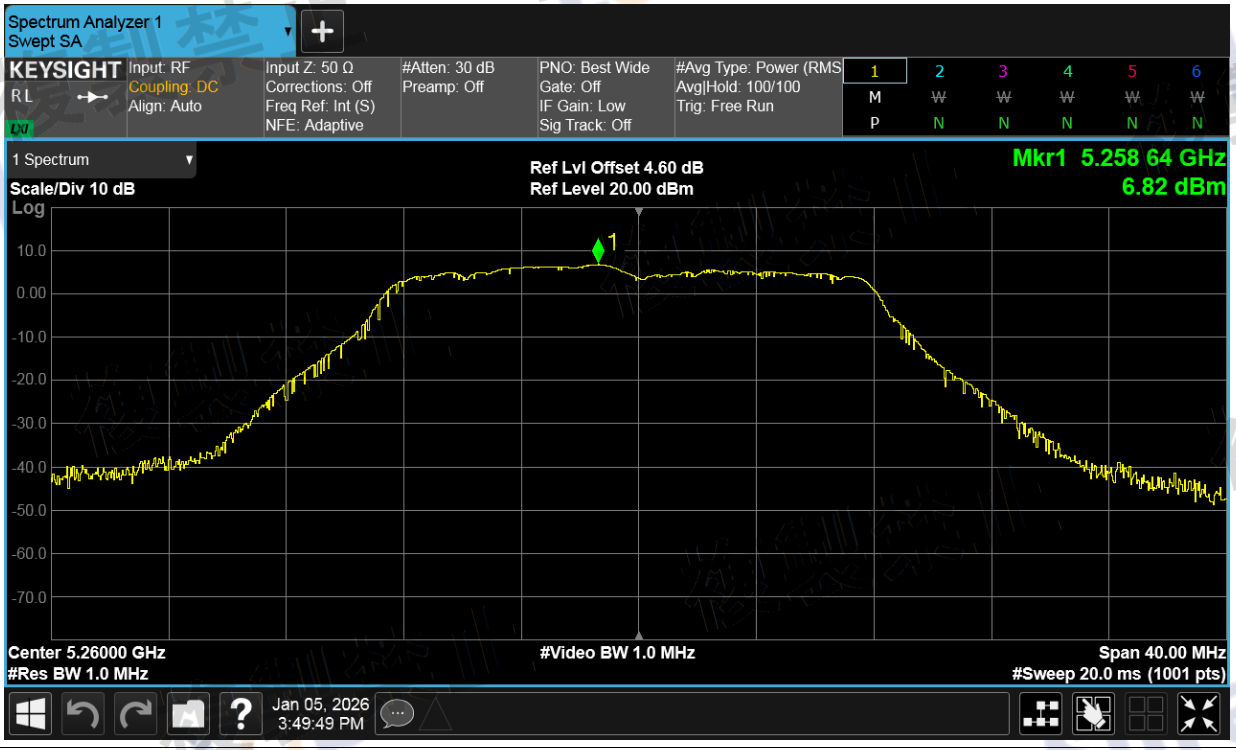


Power NVNT a 5260MHz Ant1 Zero Span

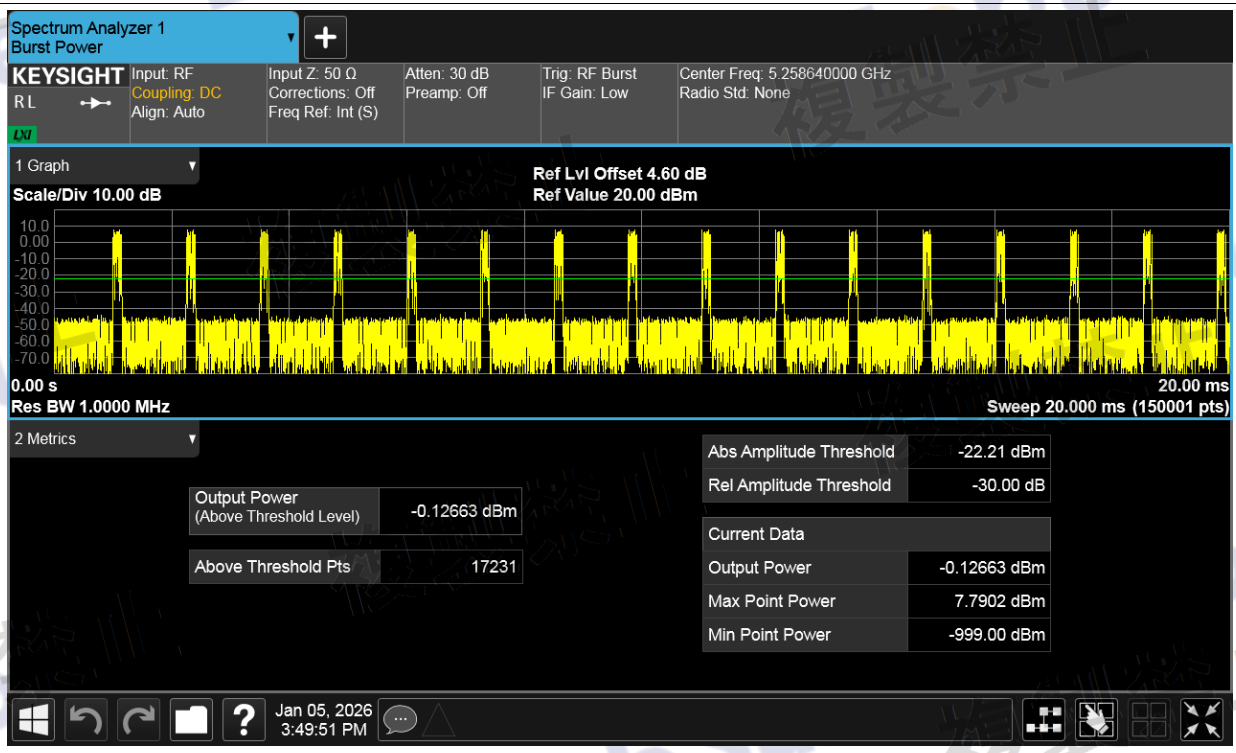


Power NVNT a 5300MHz Ant1 Pre Scan

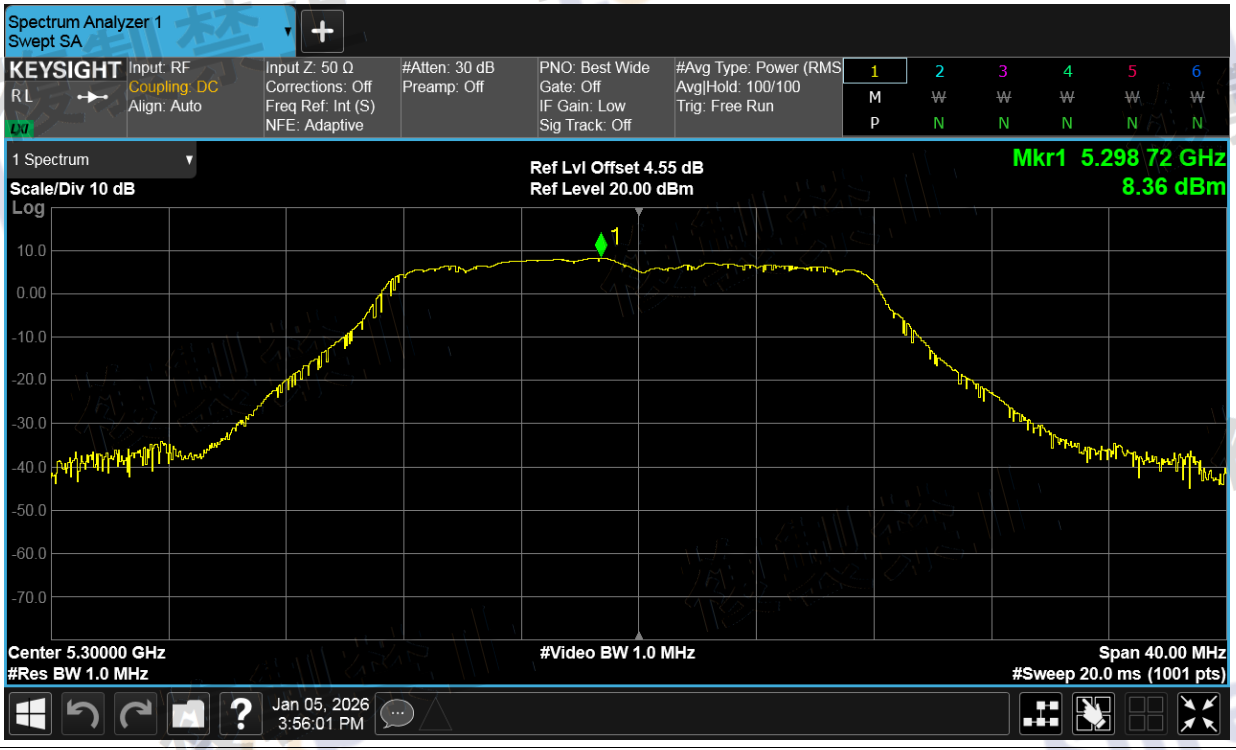


Power NVNT a 5300MHz Ant1 Zero Span

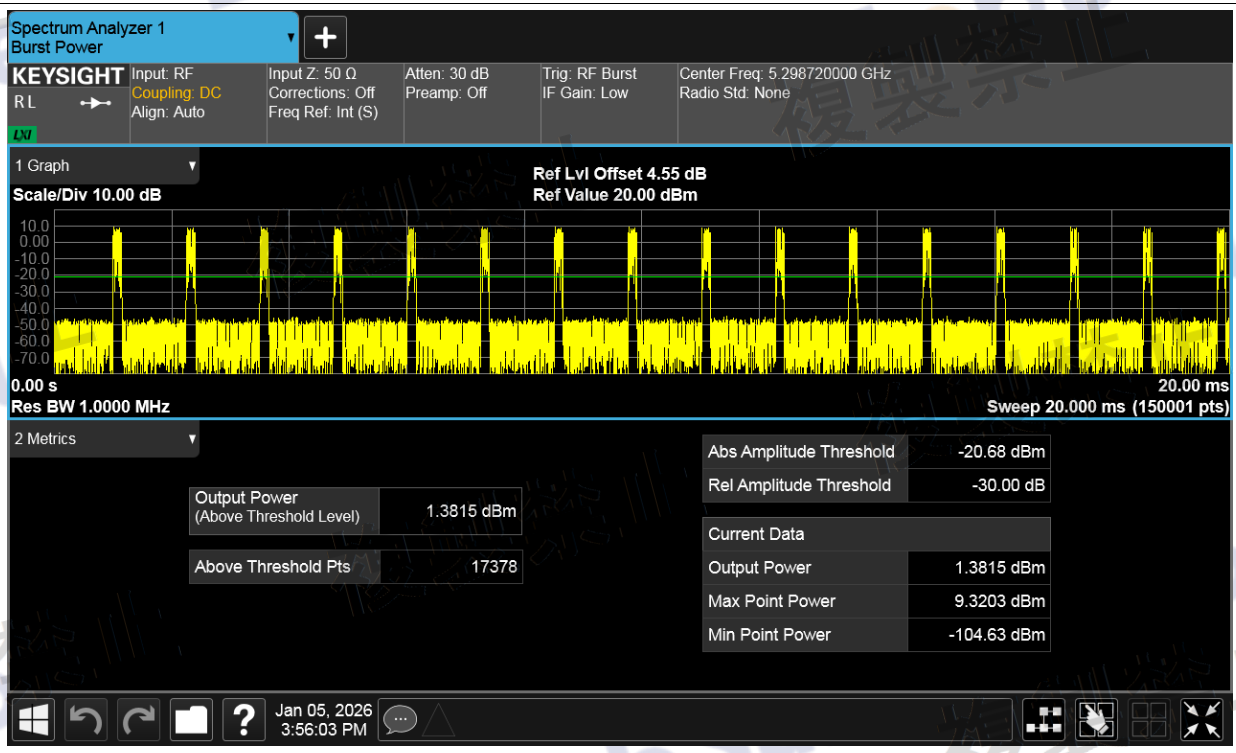


Power NVNT a 5320MHz Ant1 Pre Scan

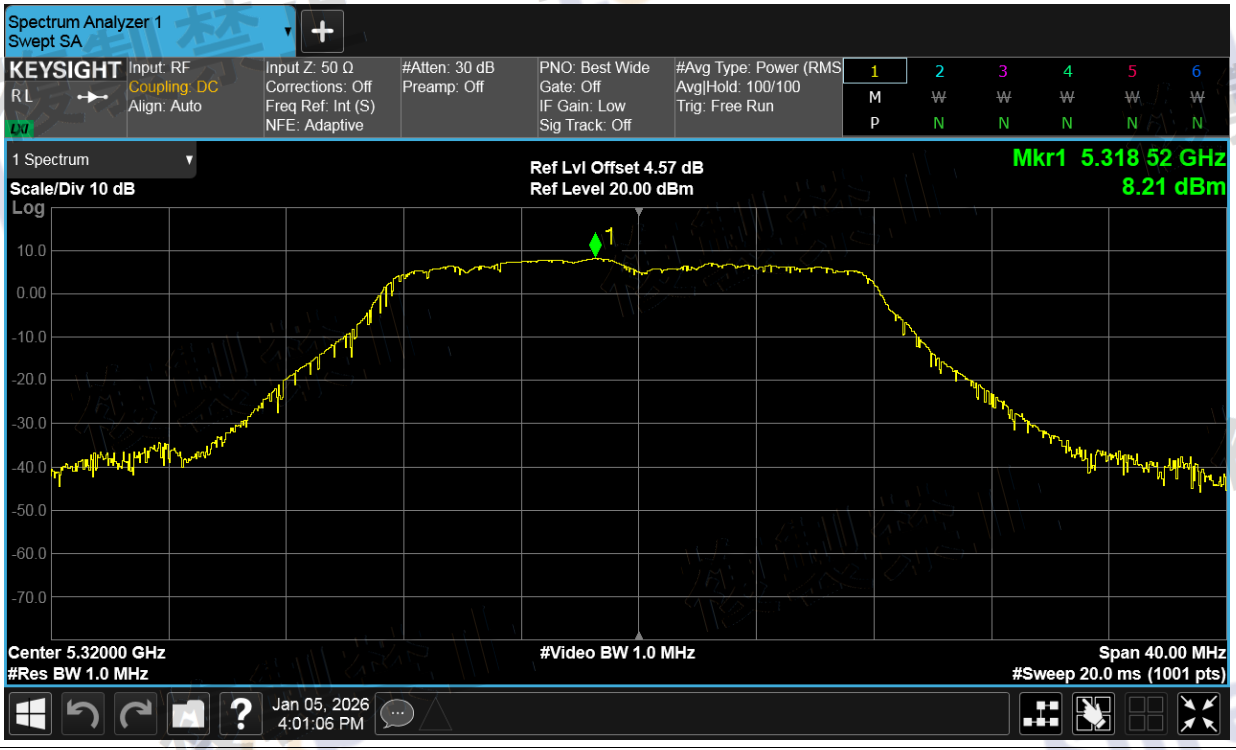


Power NVNT a 5320MHz Ant1 Zero Span

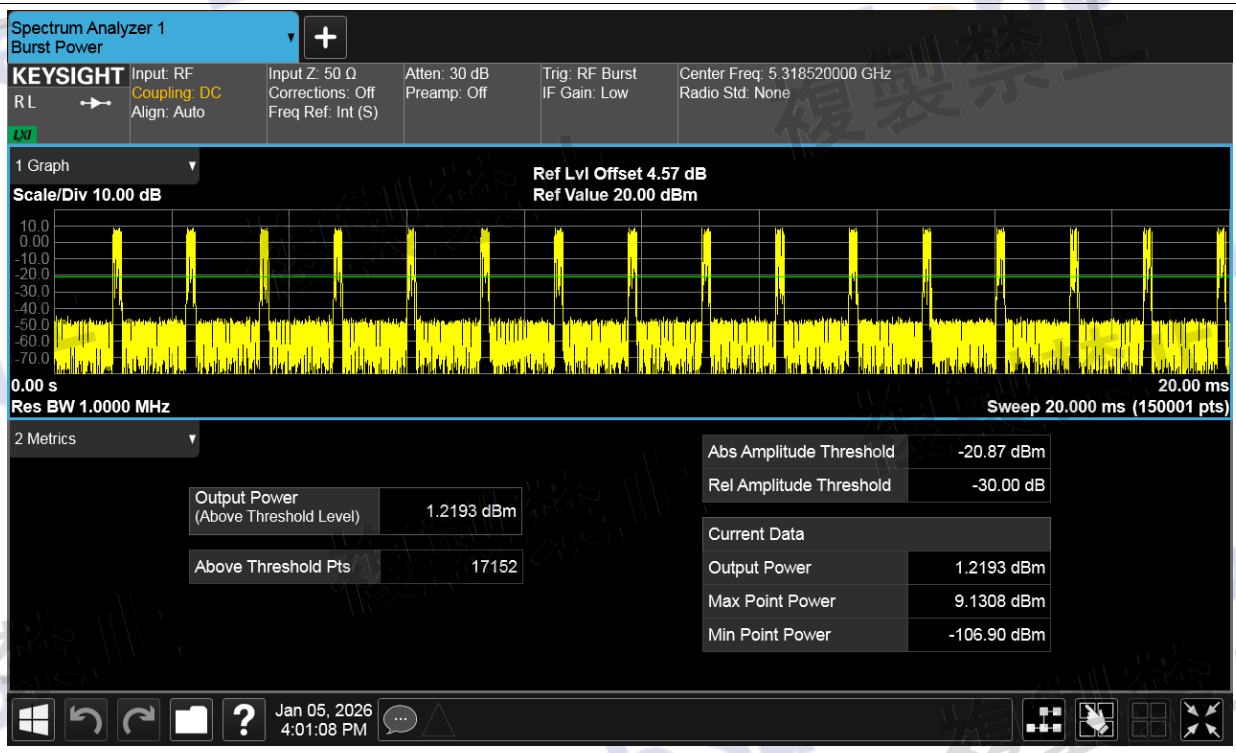


Power NVNT a 5500MHz Ant1 Pre Scan

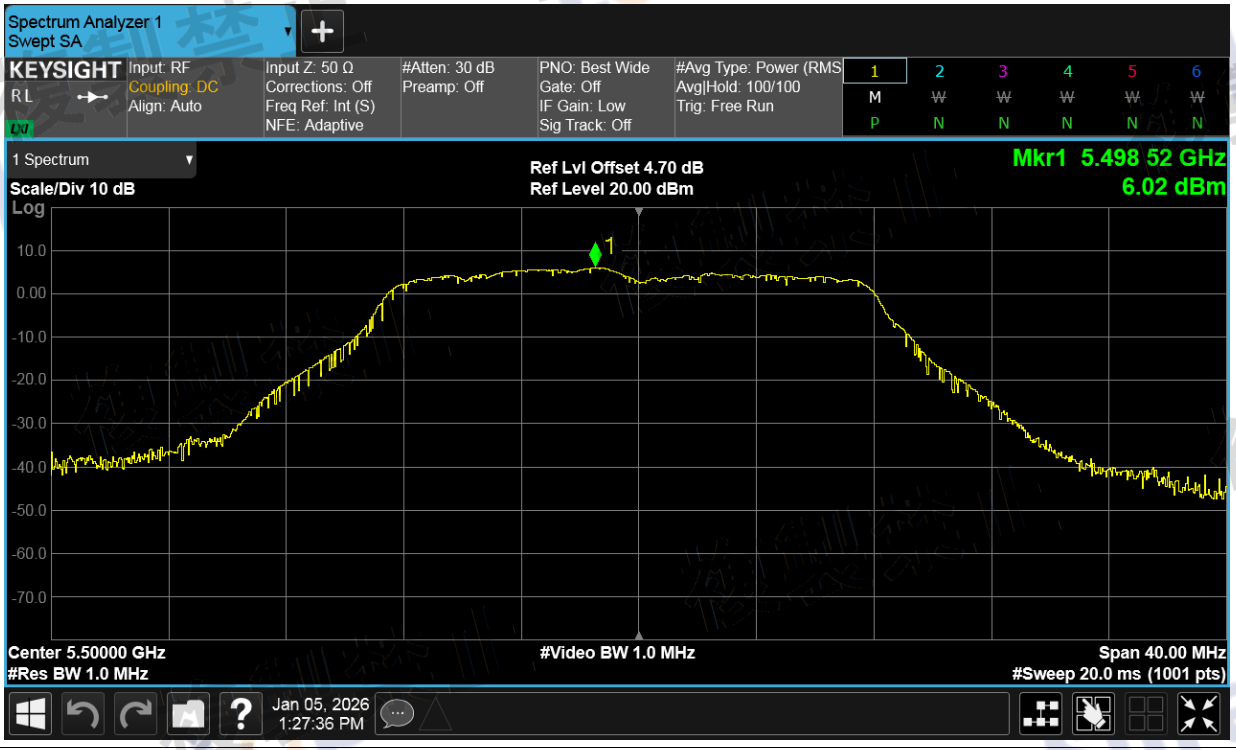


Power NVNT a 5500MHz Ant1 Zero Span

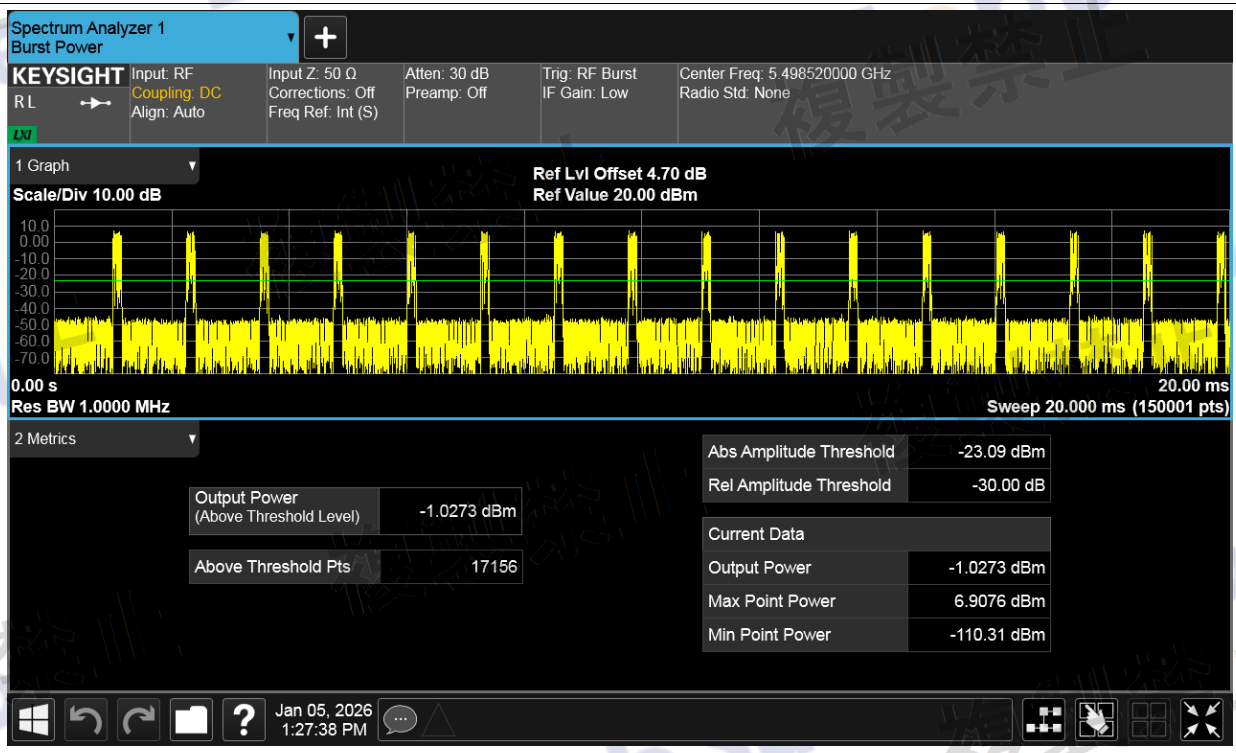


Power NVNT a 5580MHz Ant1 Pre Scan

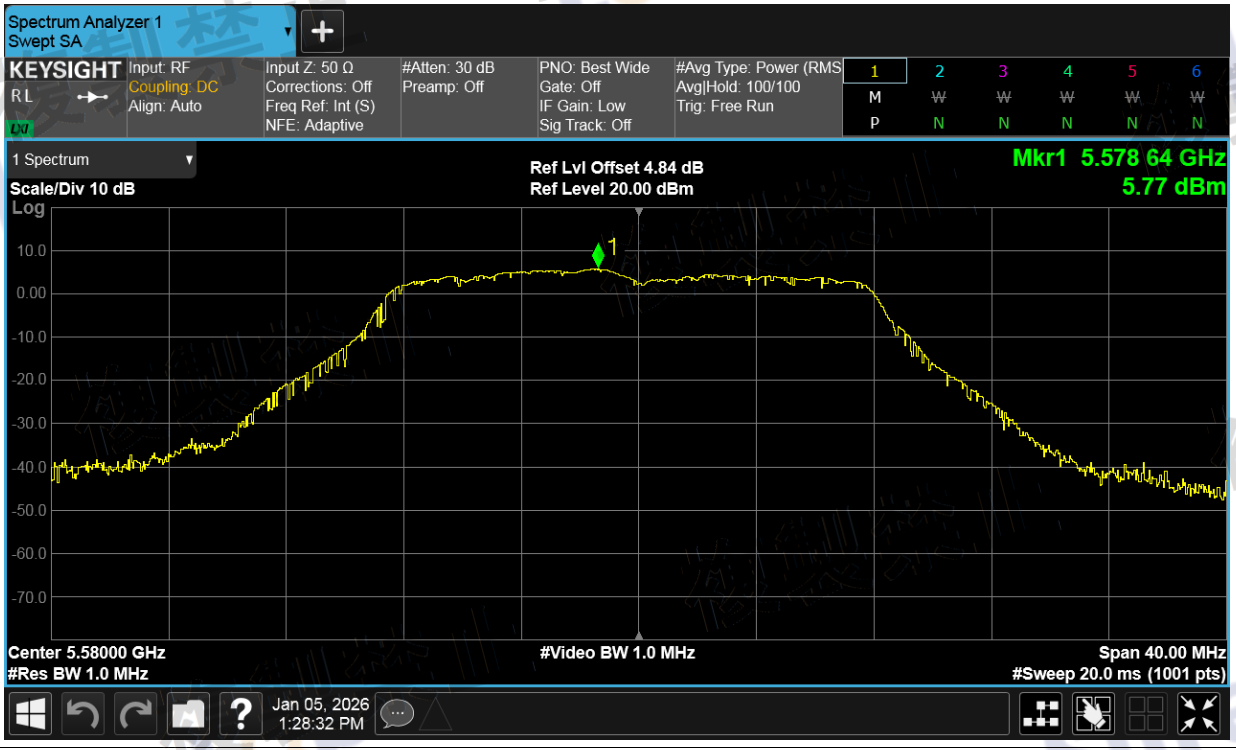


Power NVNT a 5580MHz Ant1 Zero Span

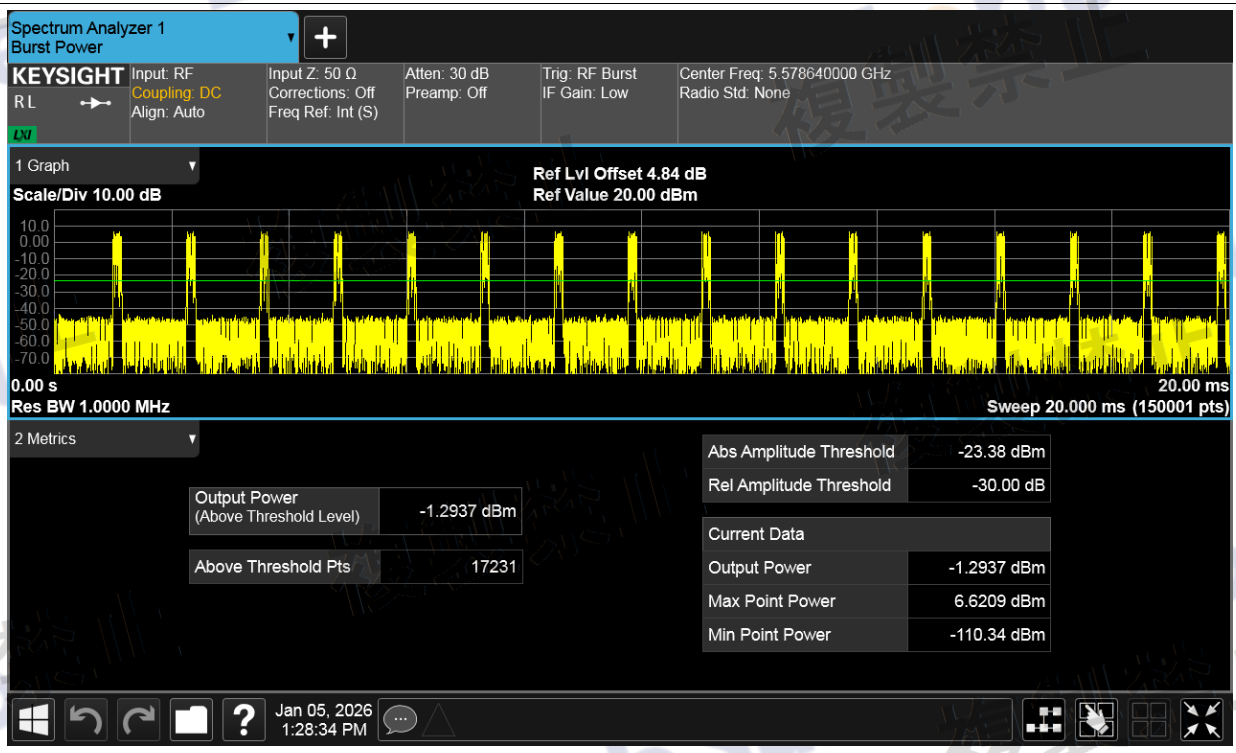


Power NVNT a 5700MHz Ant1 Pre Scan

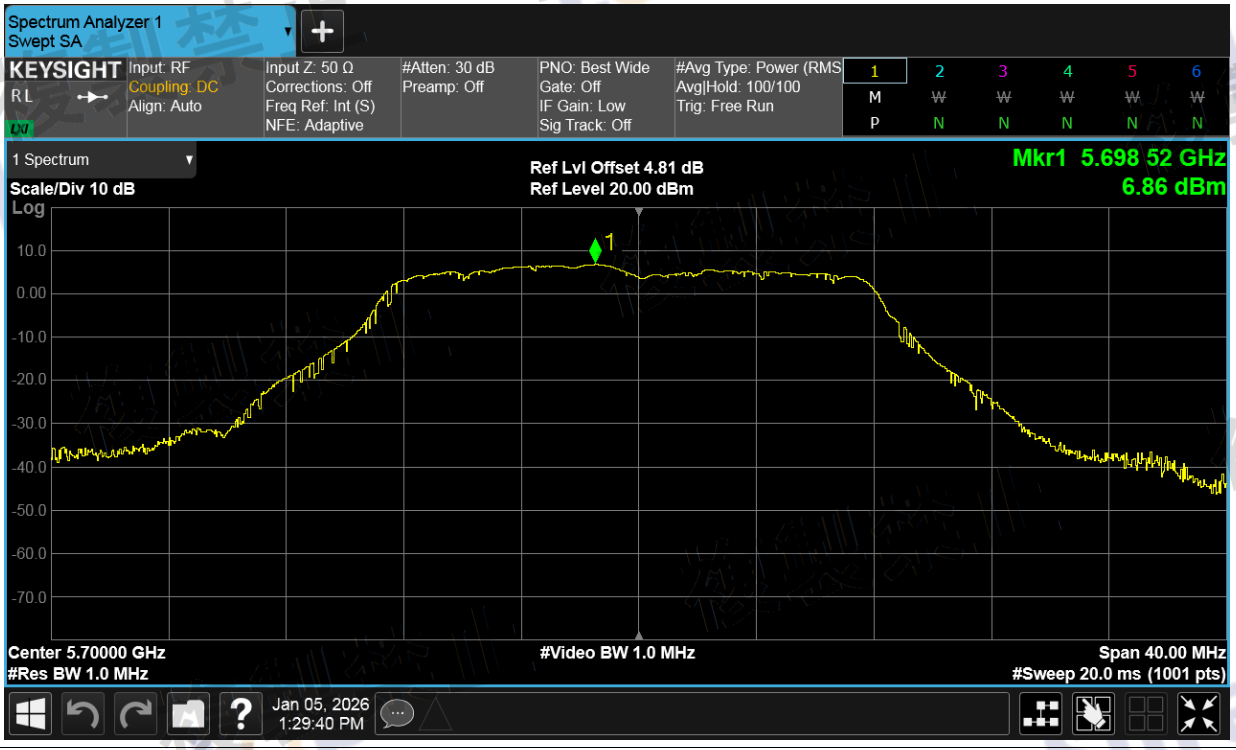


Power NVNT a 5700MHz Ant1 Zero Span

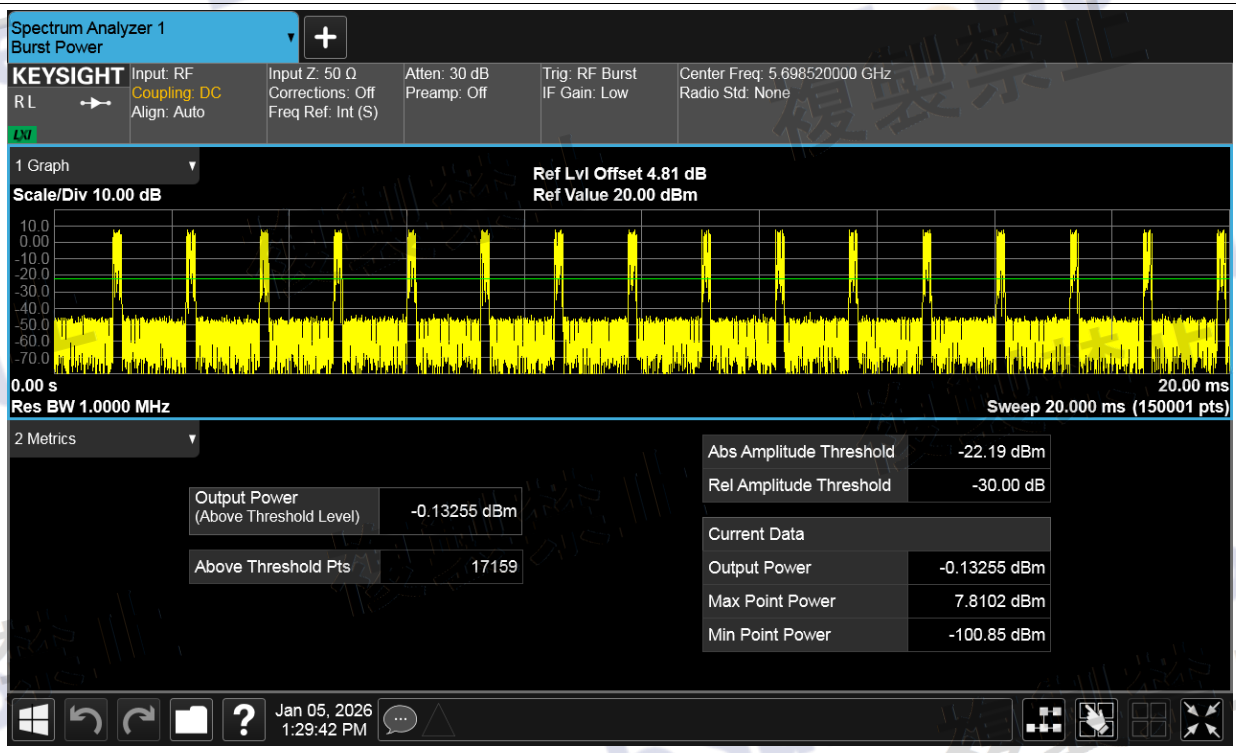


Power NVNT n20 5180MHz Ant1 Pre Scan

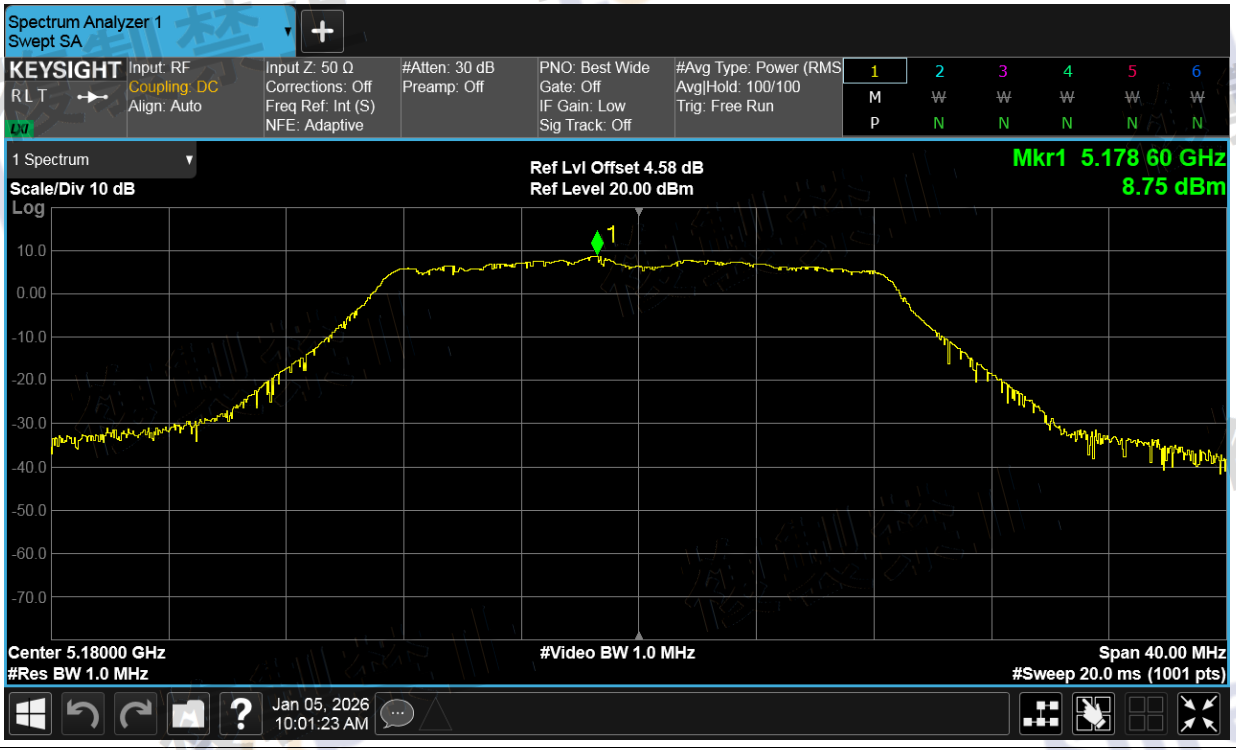


Power NVNT n20 5180MHz Ant1 Zero Span

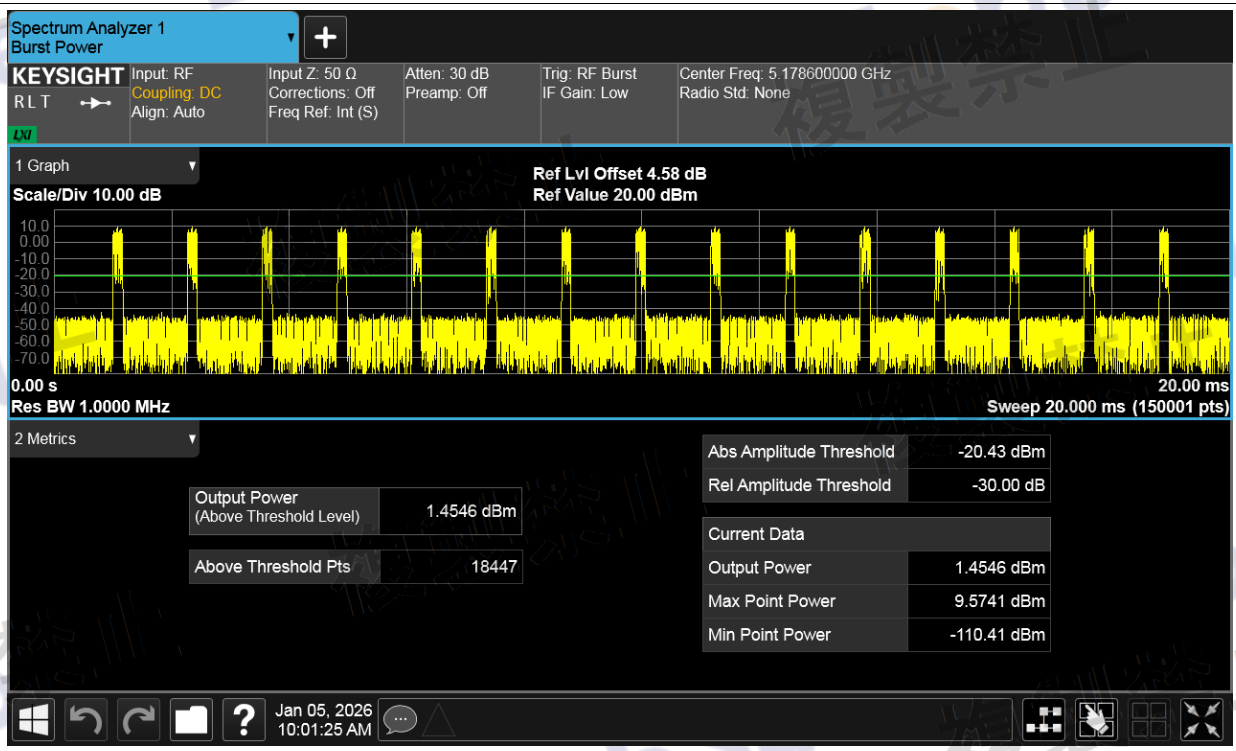


Power NVNT n20 5200MHz Ant1 Pre Scan

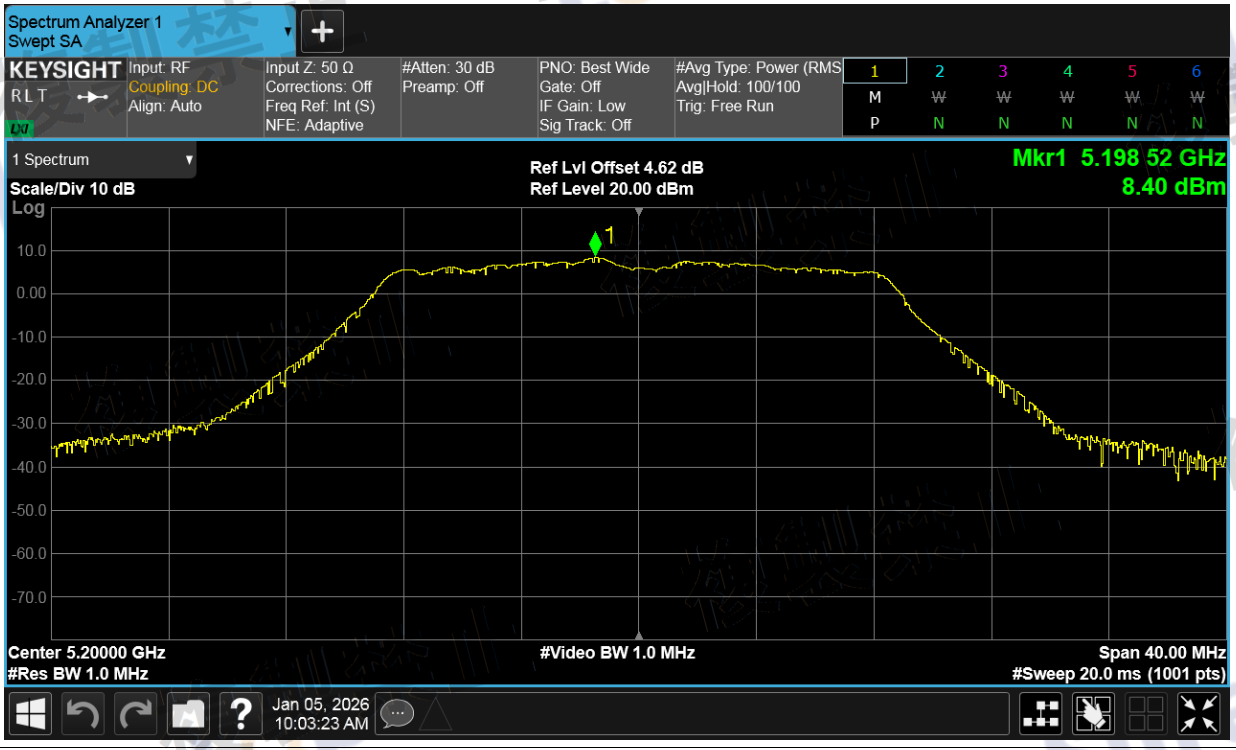


Power NVNT n20 5200MHz Ant1 Zero Span

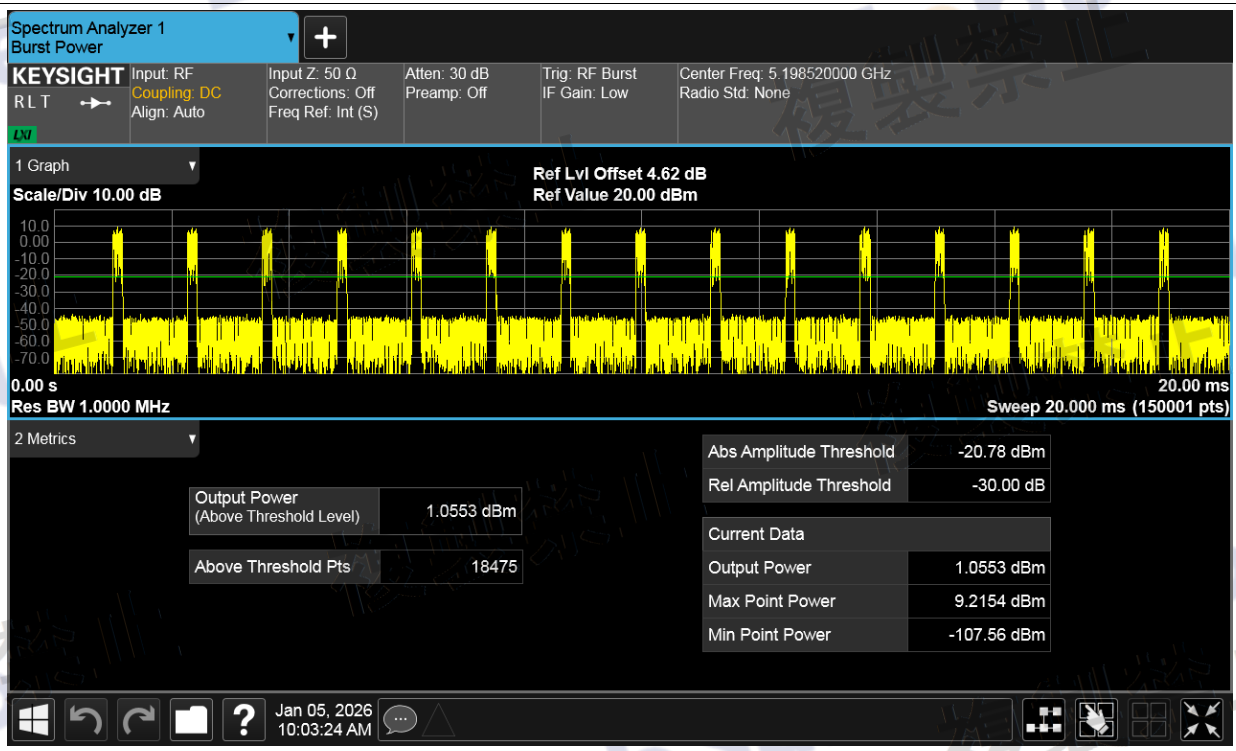


Power NVNT n20 5240MHz Ant1 Pre Scan

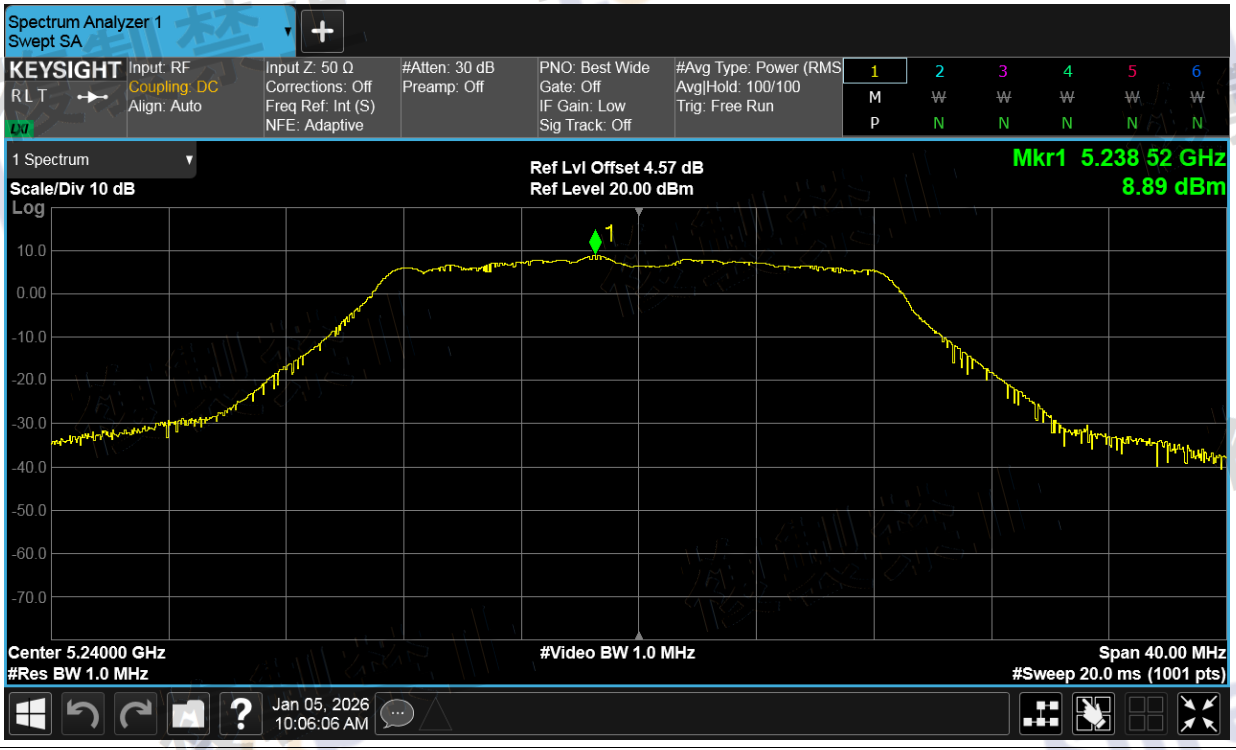


Power NVNT n20 5240MHz Ant1 Zero Span

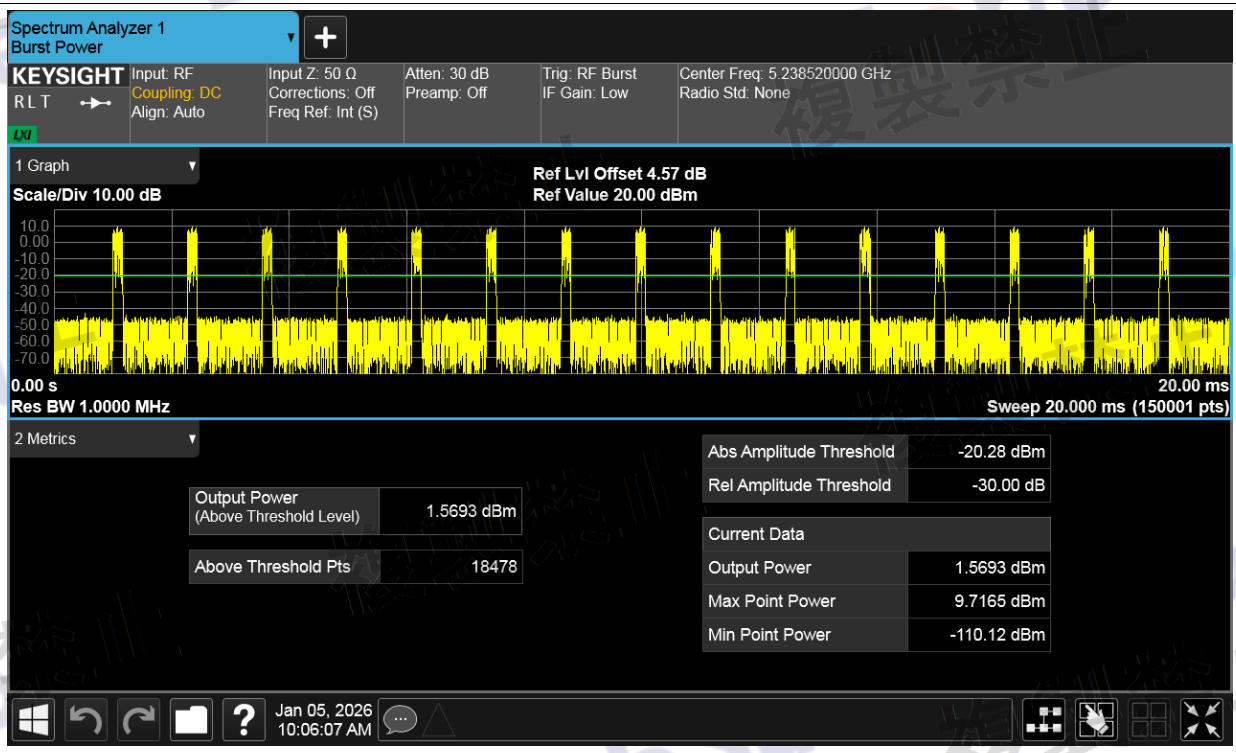


Power NVNT n20 5260MHz Ant1 Pre Scan

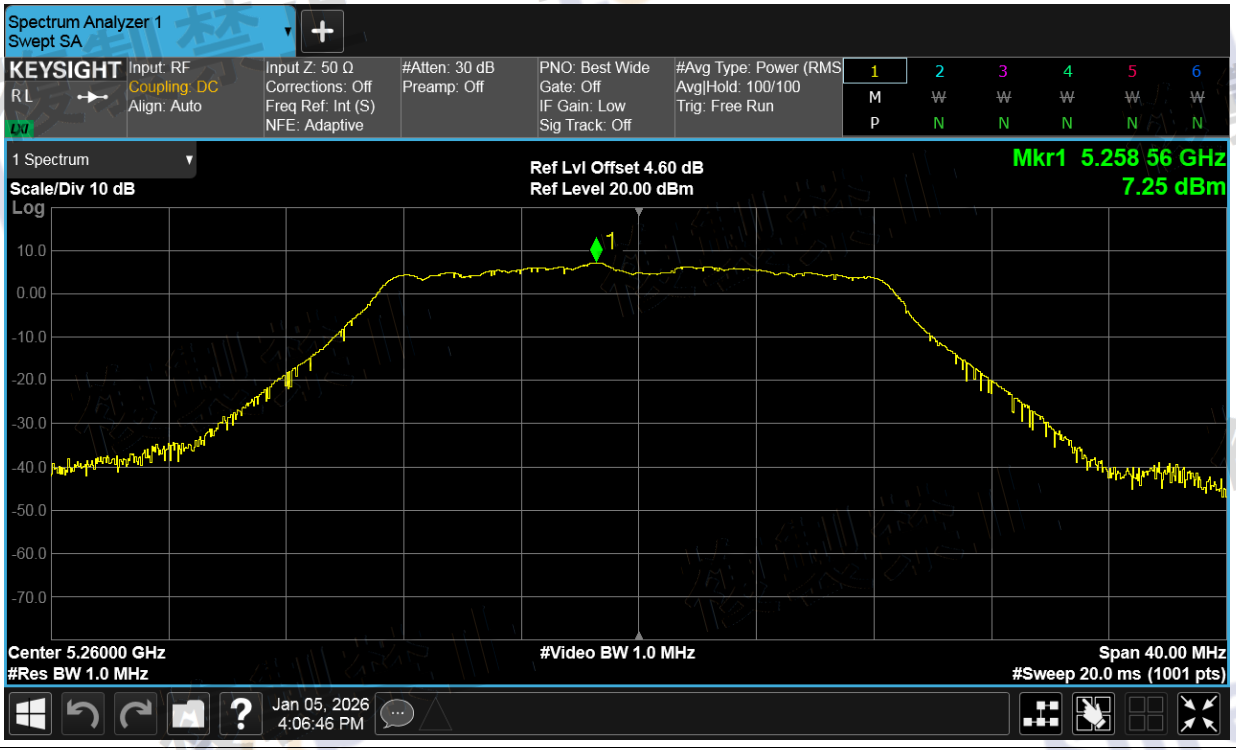


Power NVNT n20 5260MHz Ant1 Zero Span

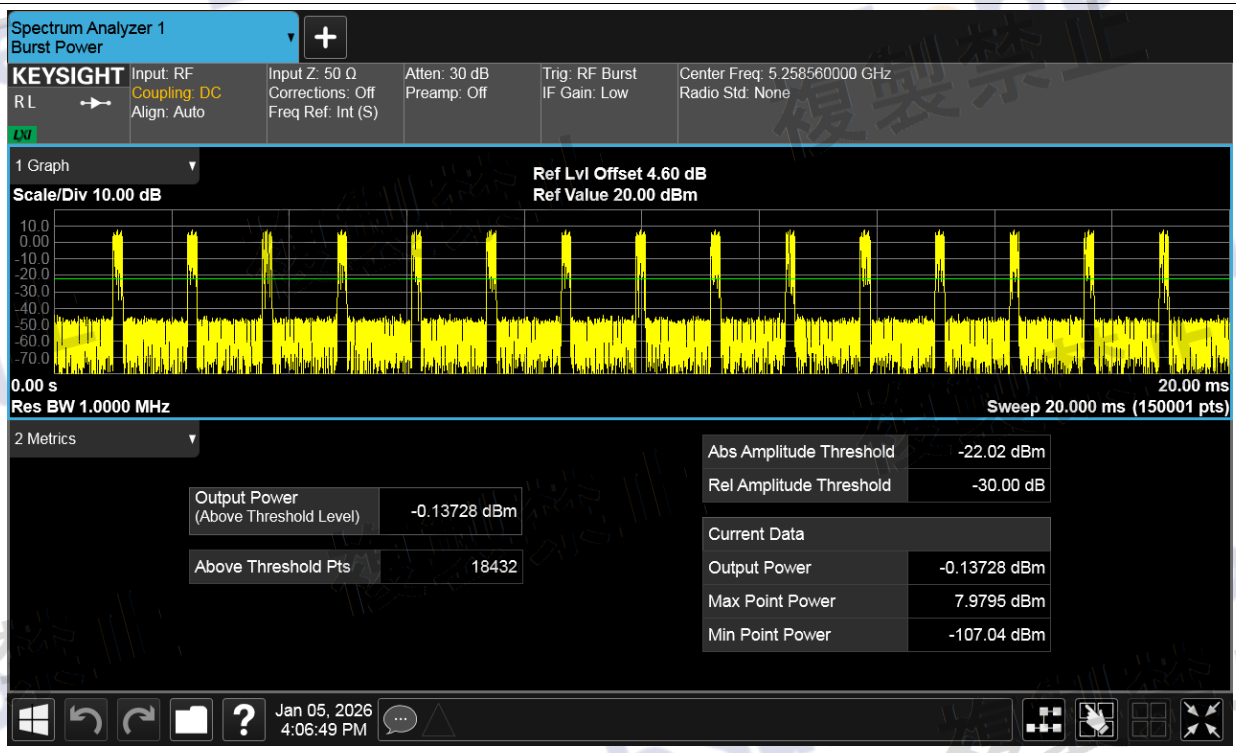


Power NVNT n20 5300MHz Ant1 Pre Scan

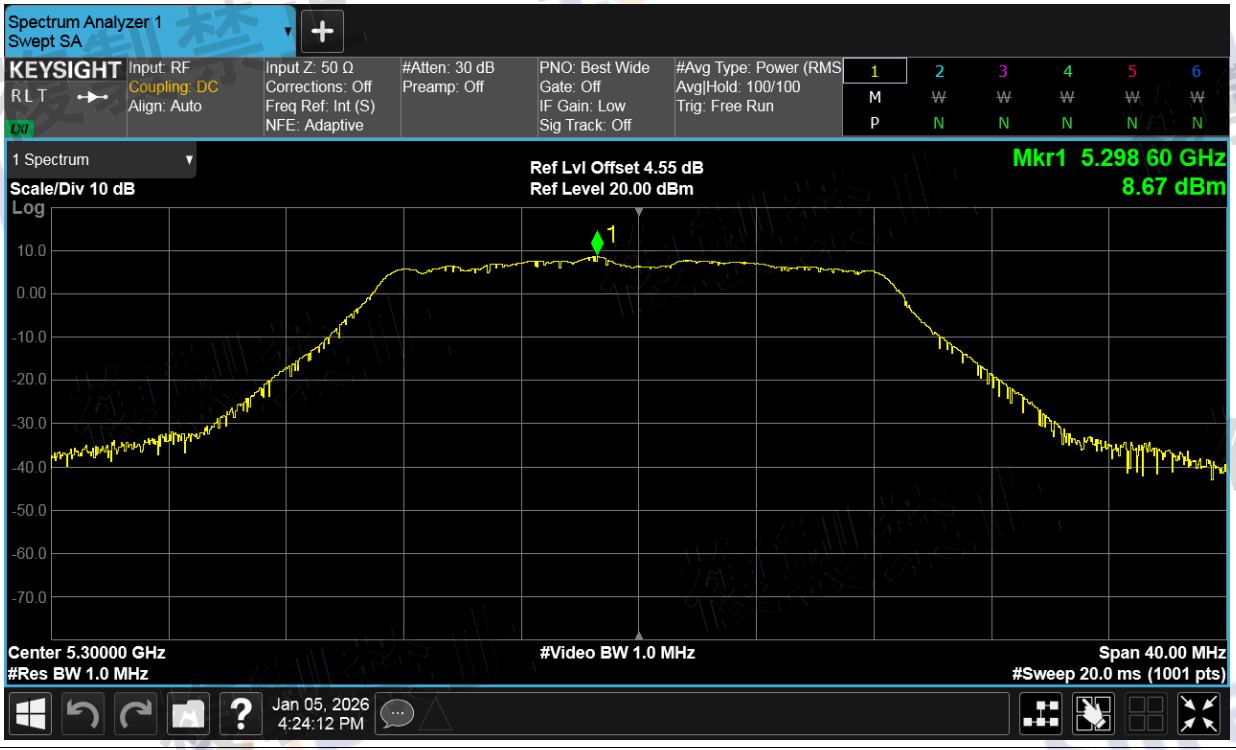


Power NVNT n20 5300MHz Ant1 Zero Span

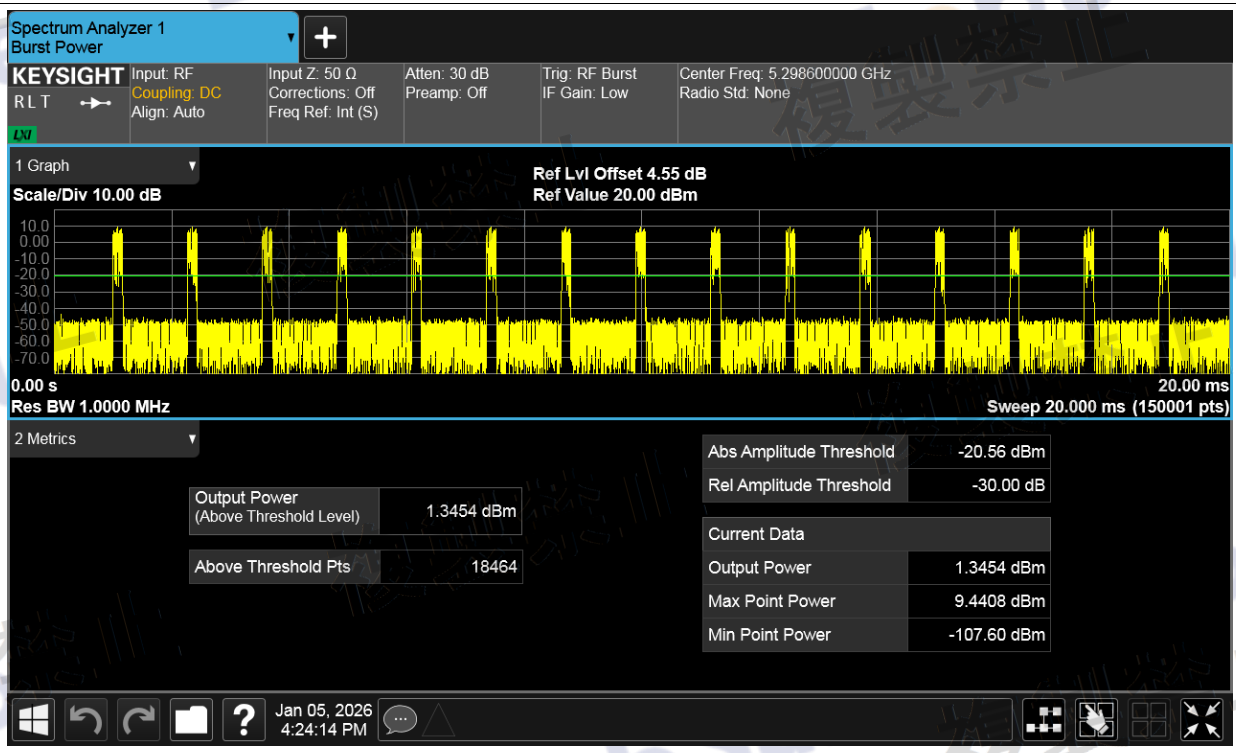


Power NVNT n20 5320MHz Ant1 Pre Scan

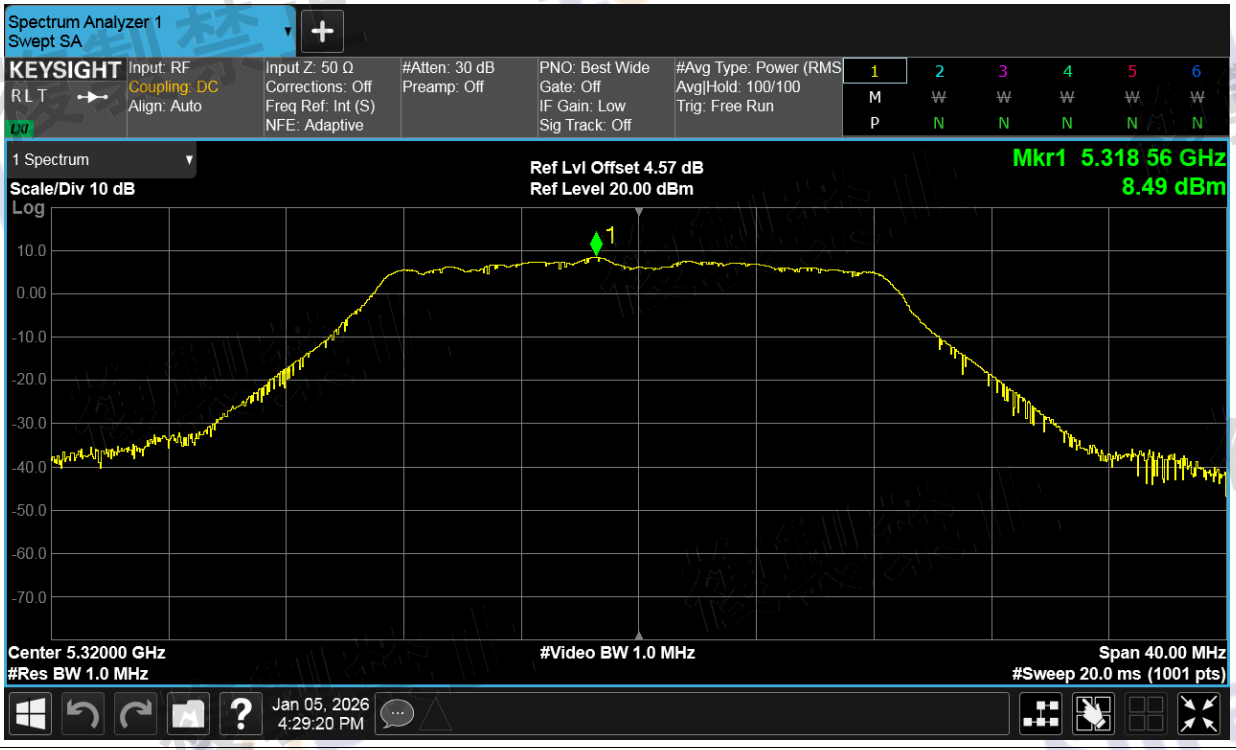


Power NVNT n20 5320MHz Ant1 Zero Span

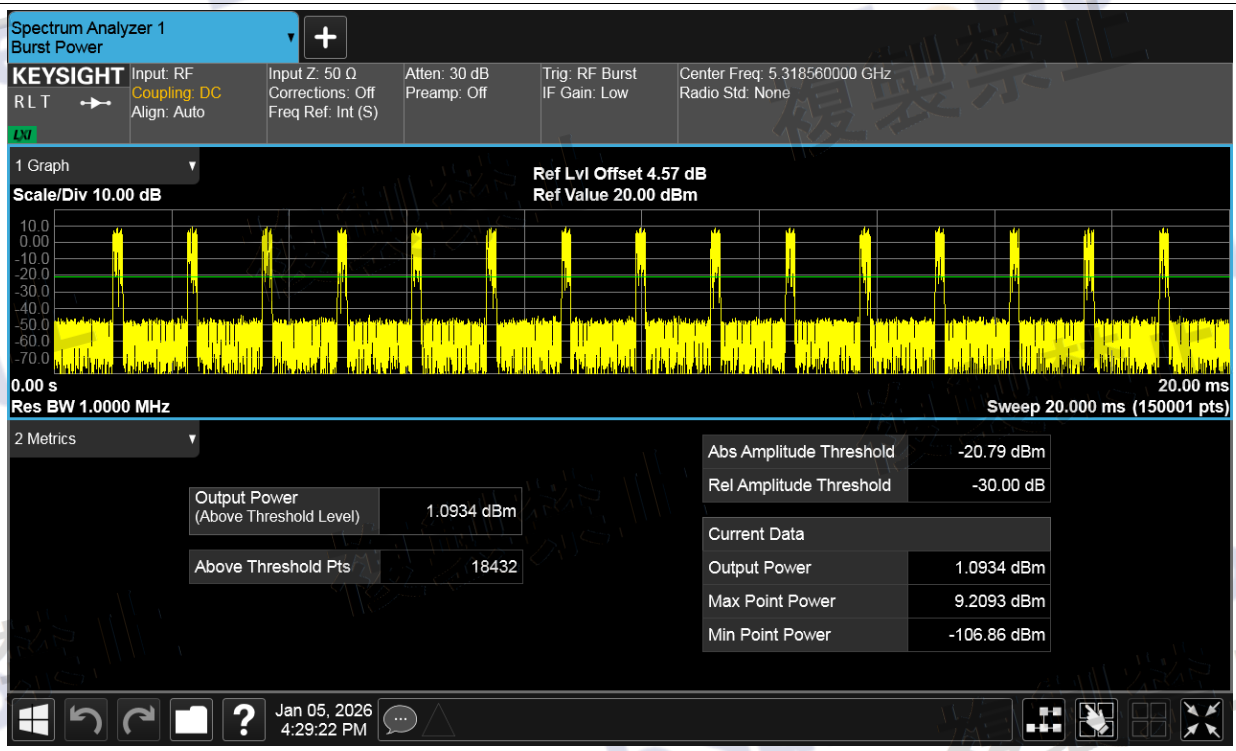


Power NVNT n20 5500MHz Ant1 Pre Scan

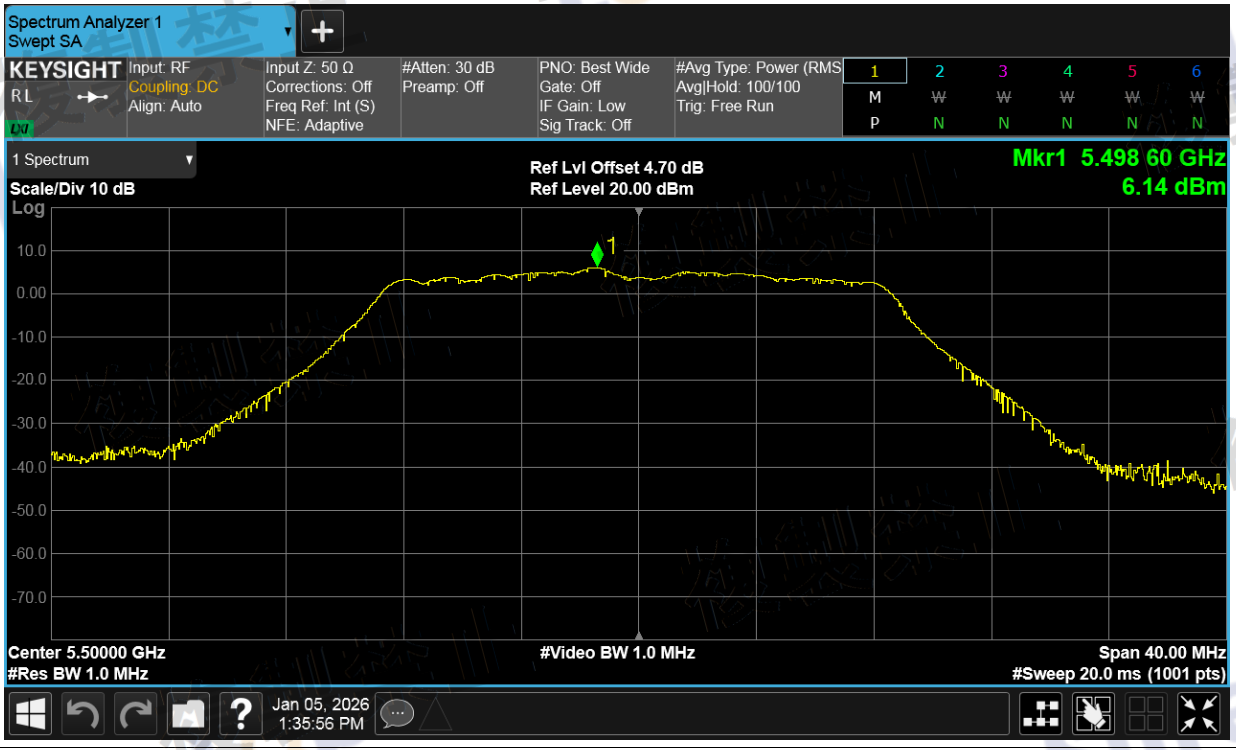


Power NVNT n20 5500MHz Ant1 Zero Span

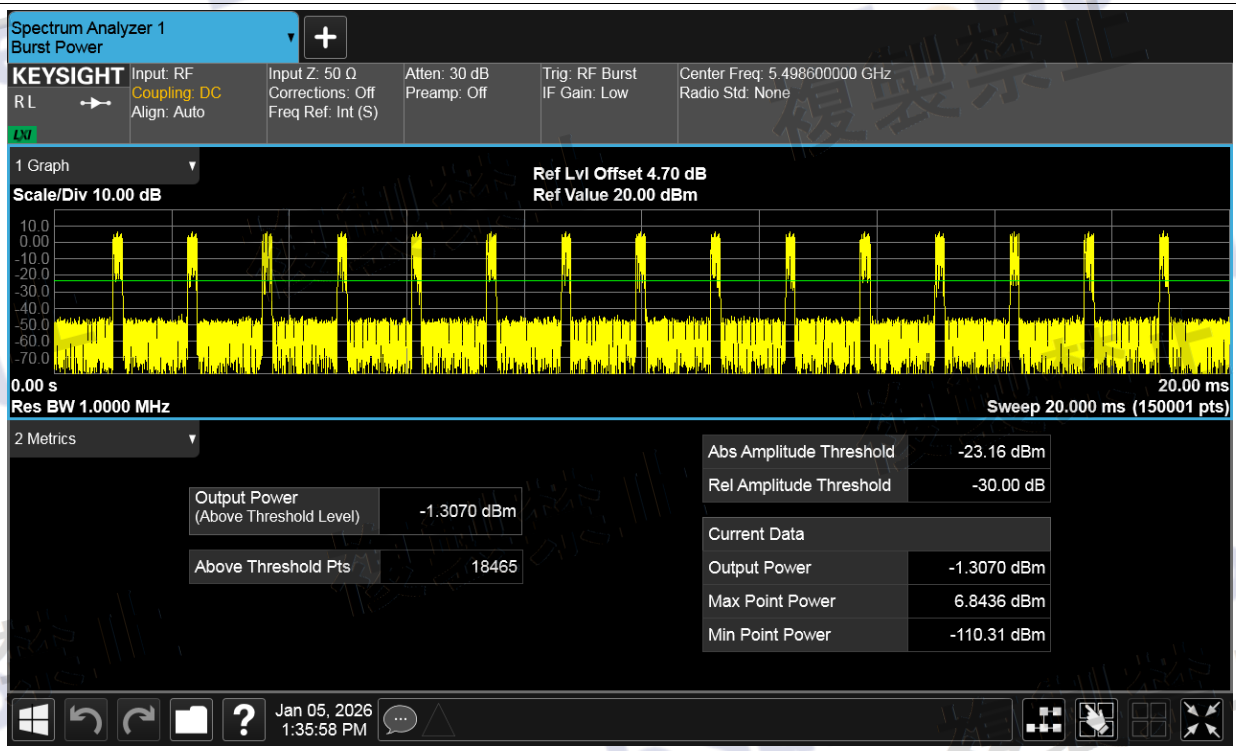


Power NVNT n20 5580MHz Ant1 Pre Scan

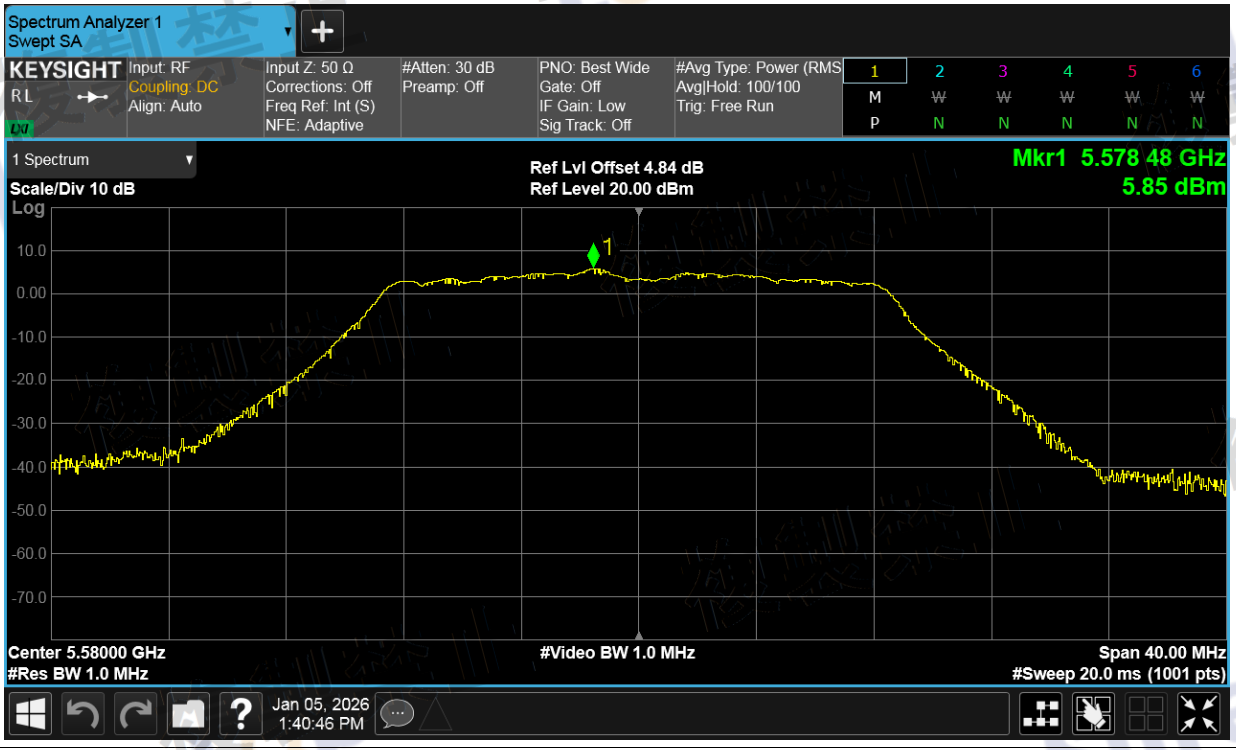


Power NVNT n20 5580MHz Ant1 Zero Span

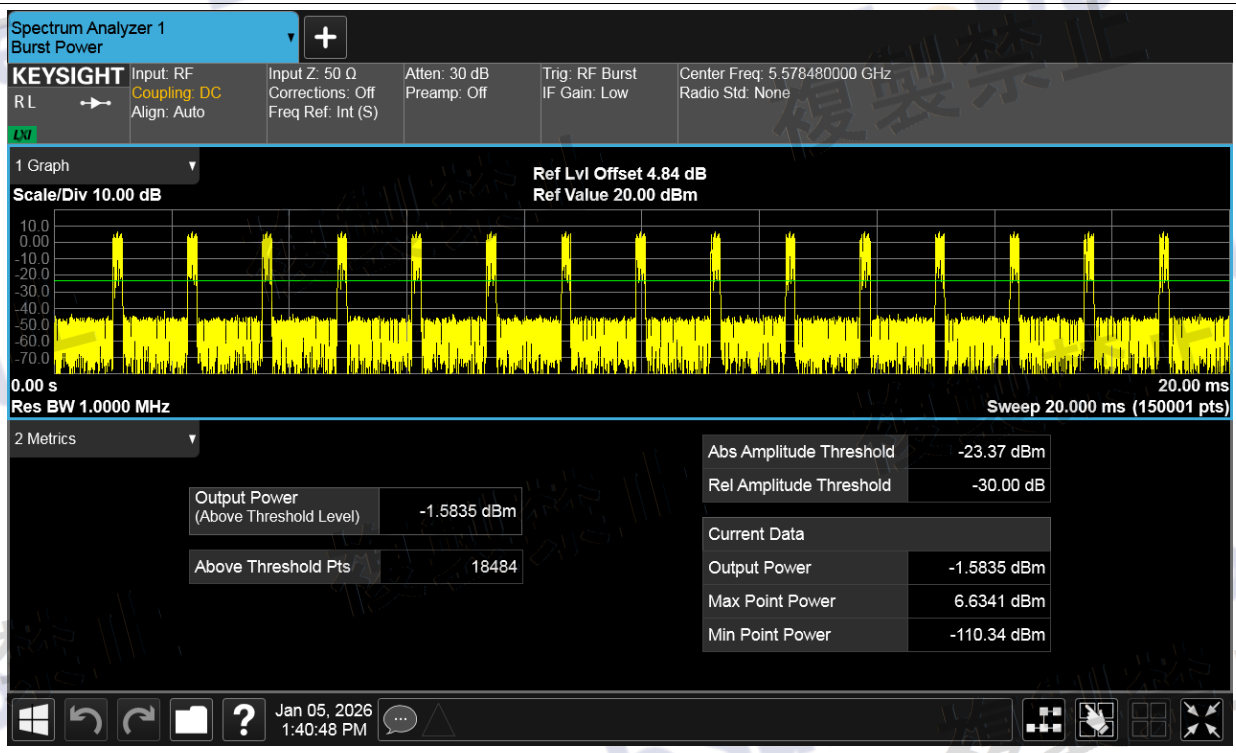


Power NVNT n20 5700MHz Ant1 Pre Scan

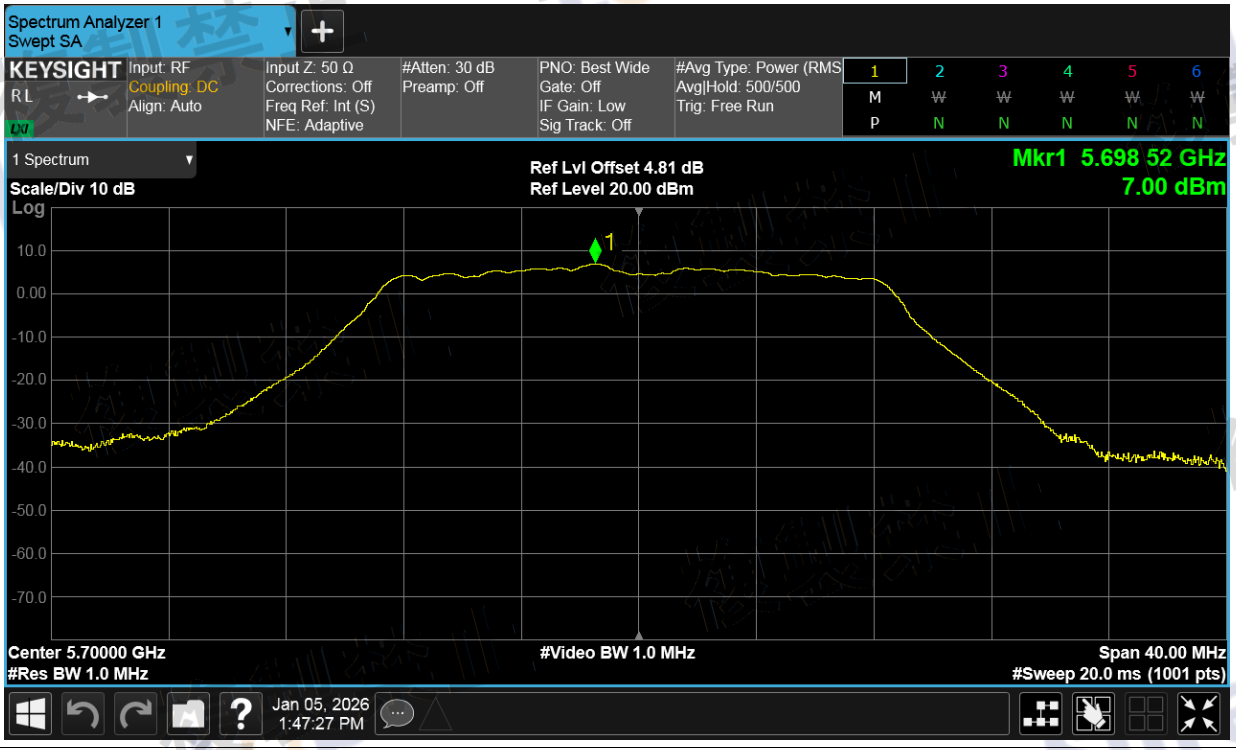


Power NVNT n20 5700MHz Ant1 Zero Span

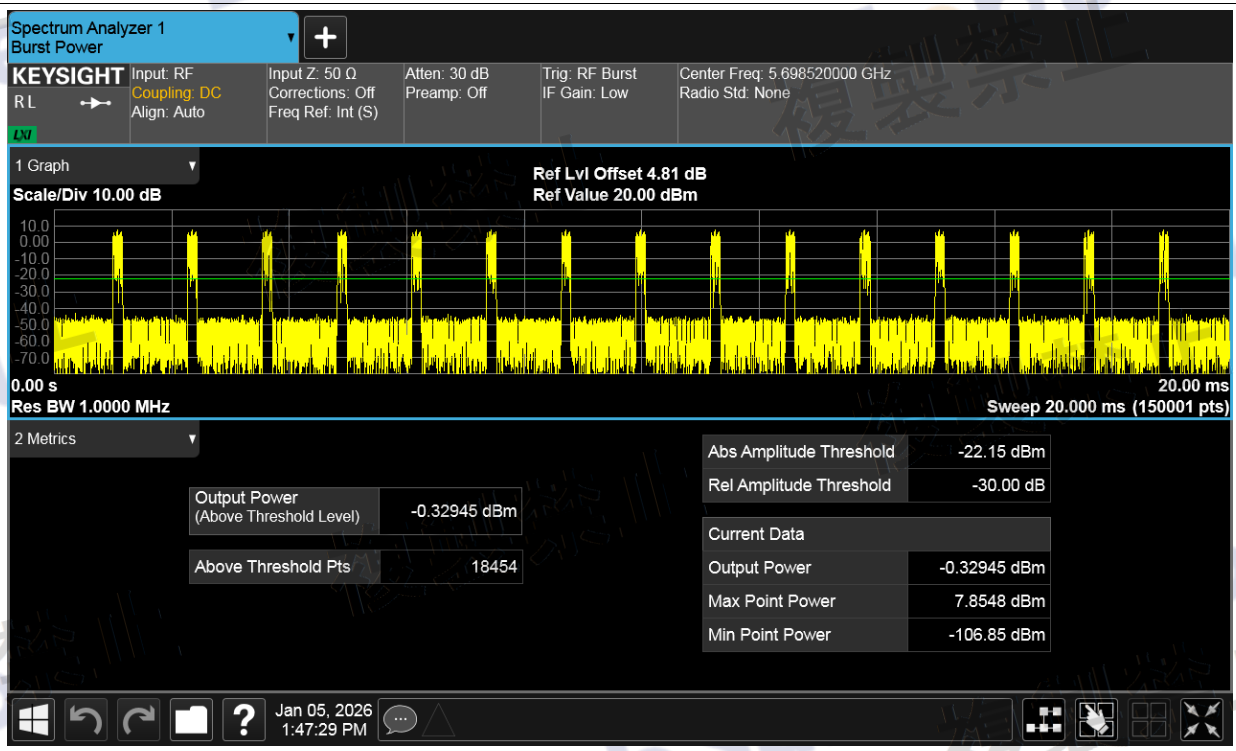


Power NVNT n40 5190MHz Ant1 Pre Scan

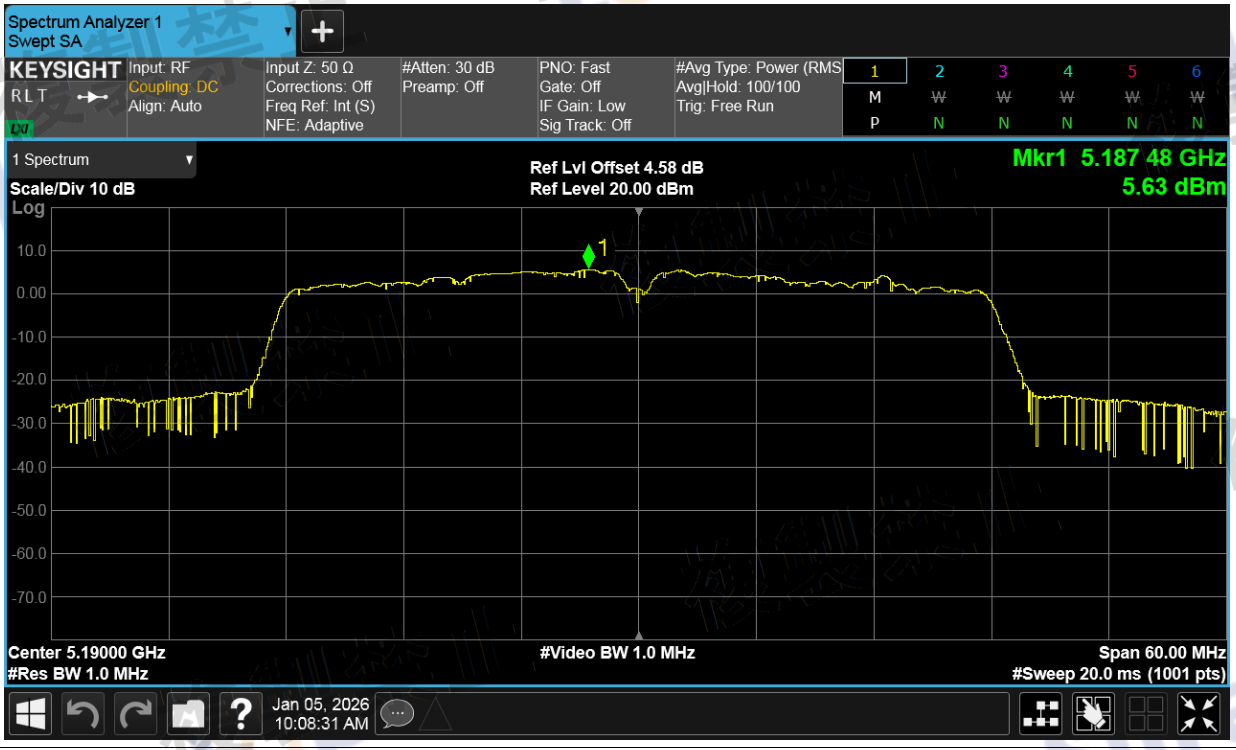


Power NVNT n40 5190MHz Ant1 Zero Span

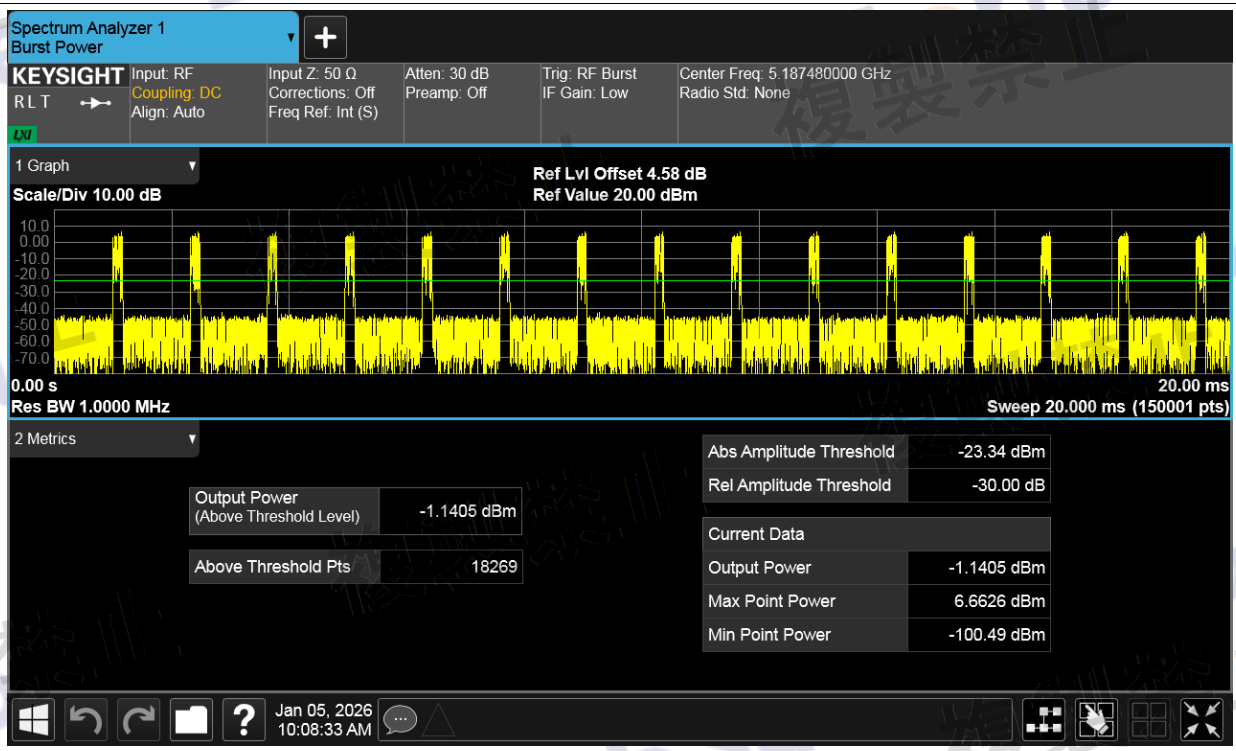


Power NVNT n40 5200MHz Ant1 Pre Scan

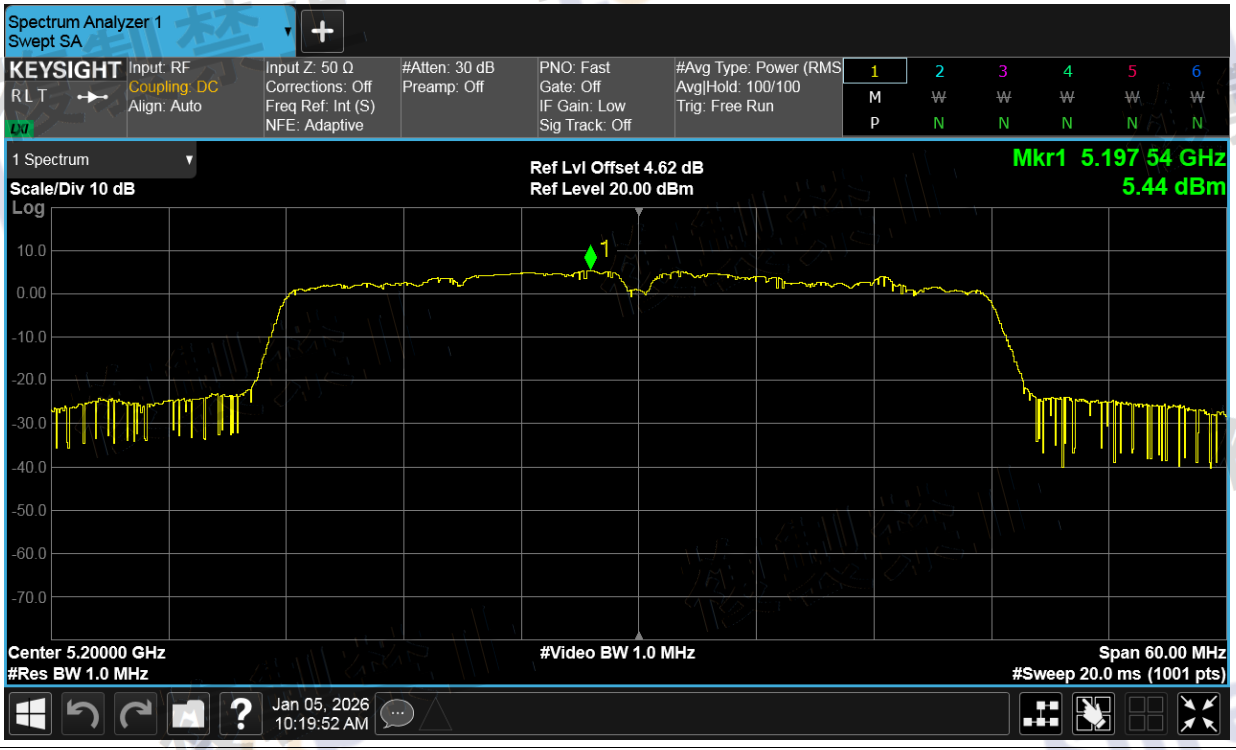


Power NVNT n40 5200MHz Ant1 Zero Span

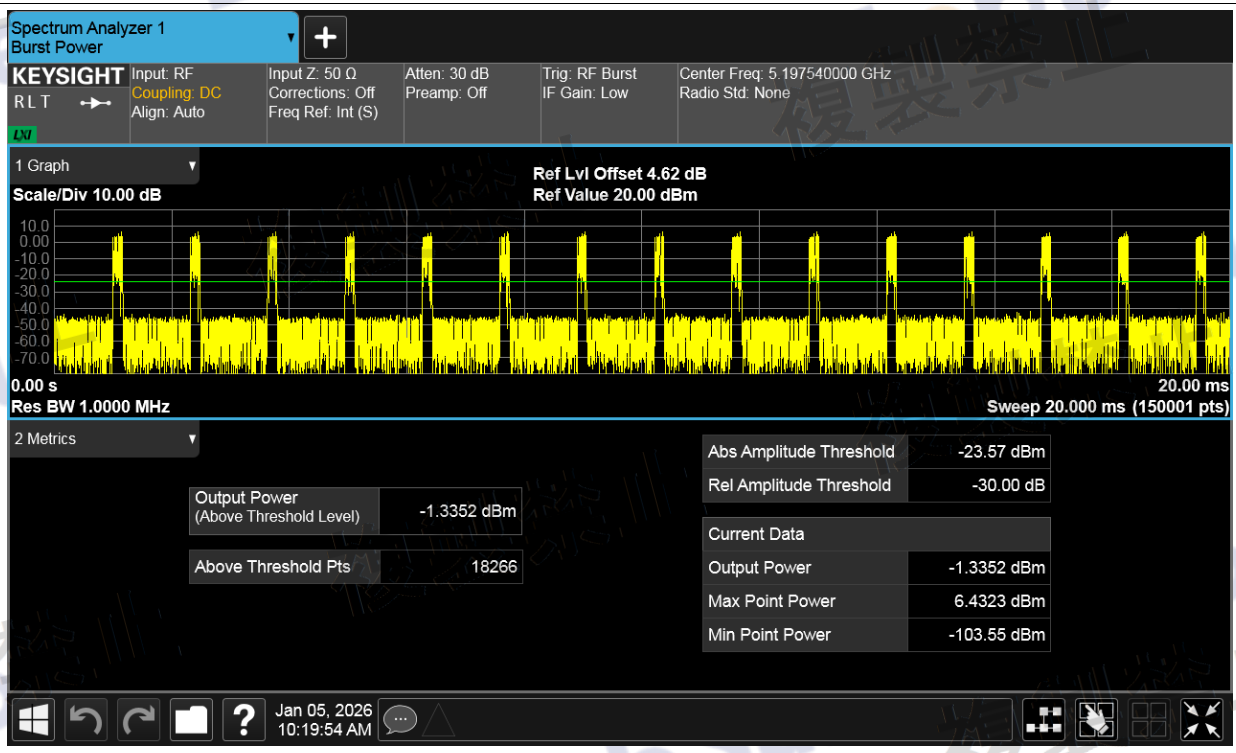


Power NVNT n40 5230MHz Ant1 Pre Scan

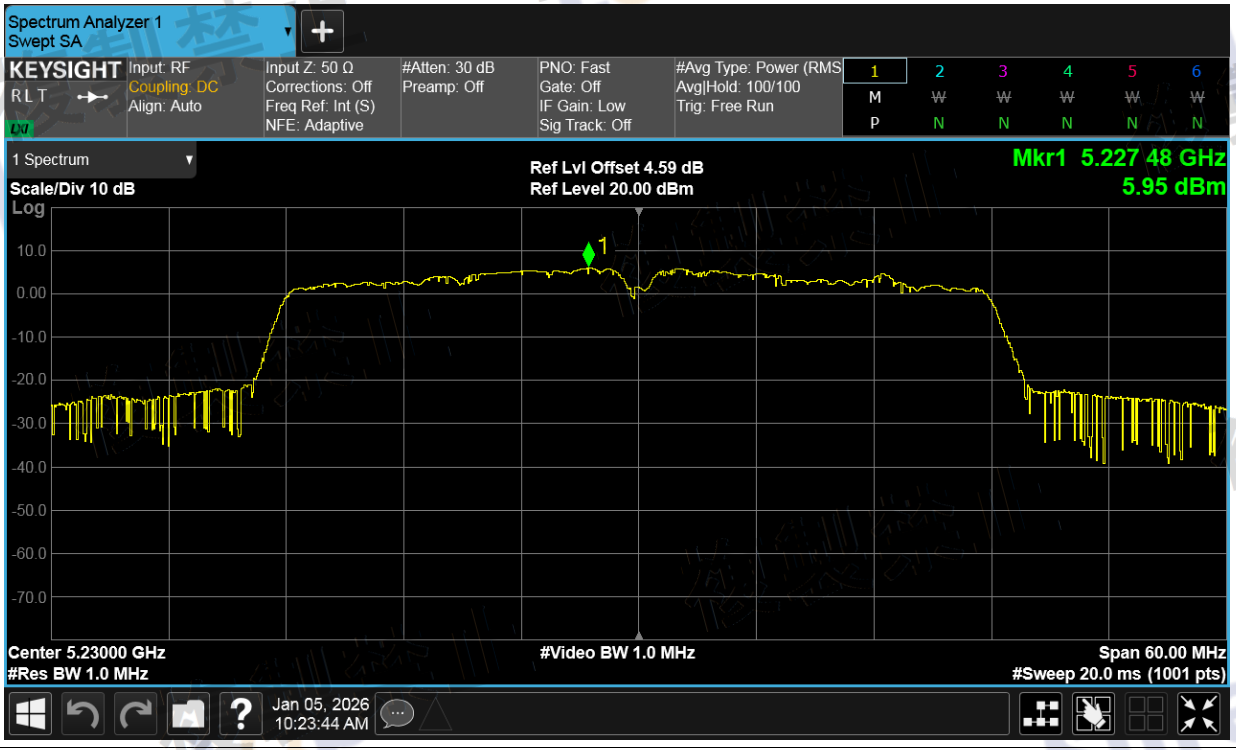


Power NVNT n40 5230MHz Ant1 Zero Span

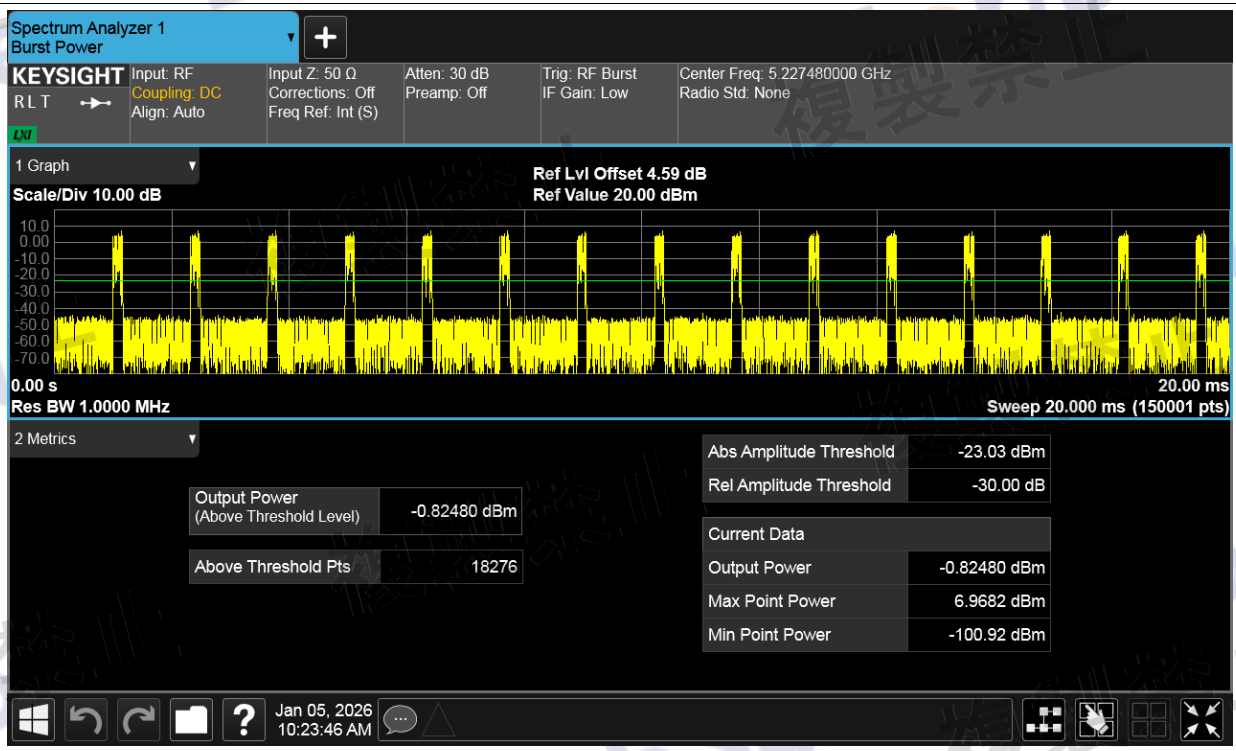


Power NVNT n40 5270MHz Ant1 Pre Scan

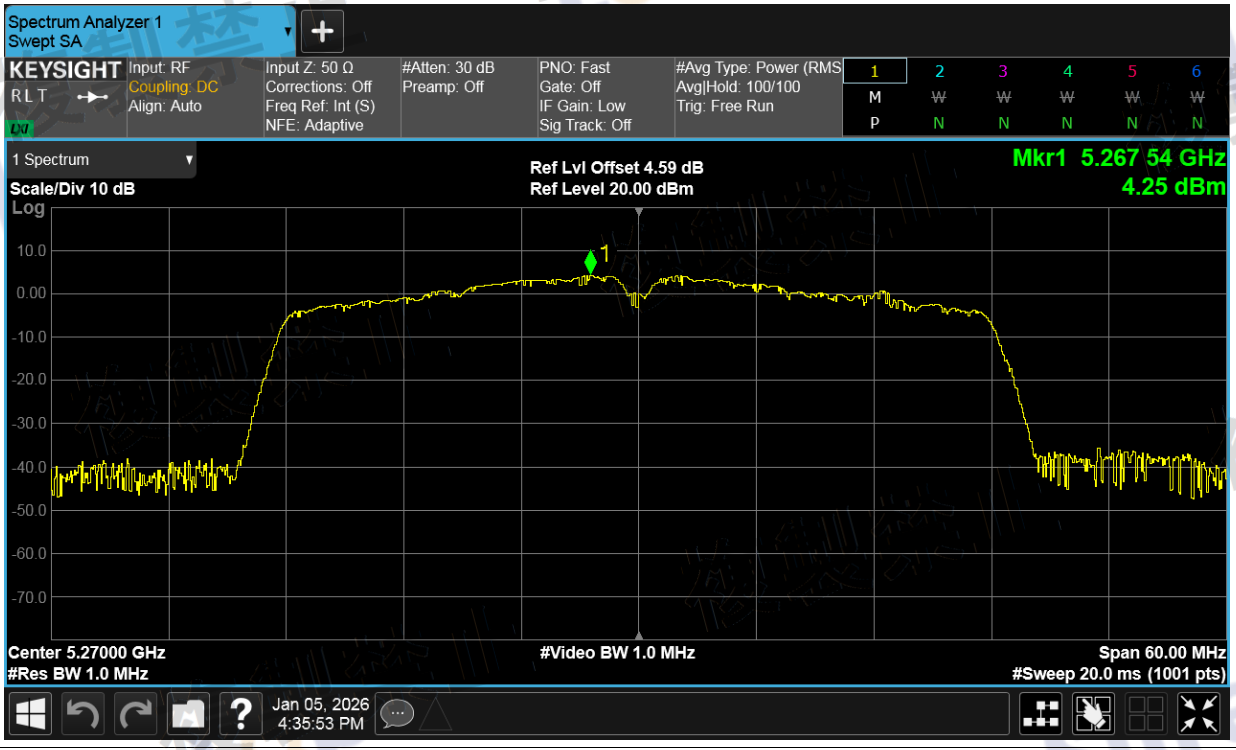


Power NVNT n40 5270MHz Ant1 Zero Span

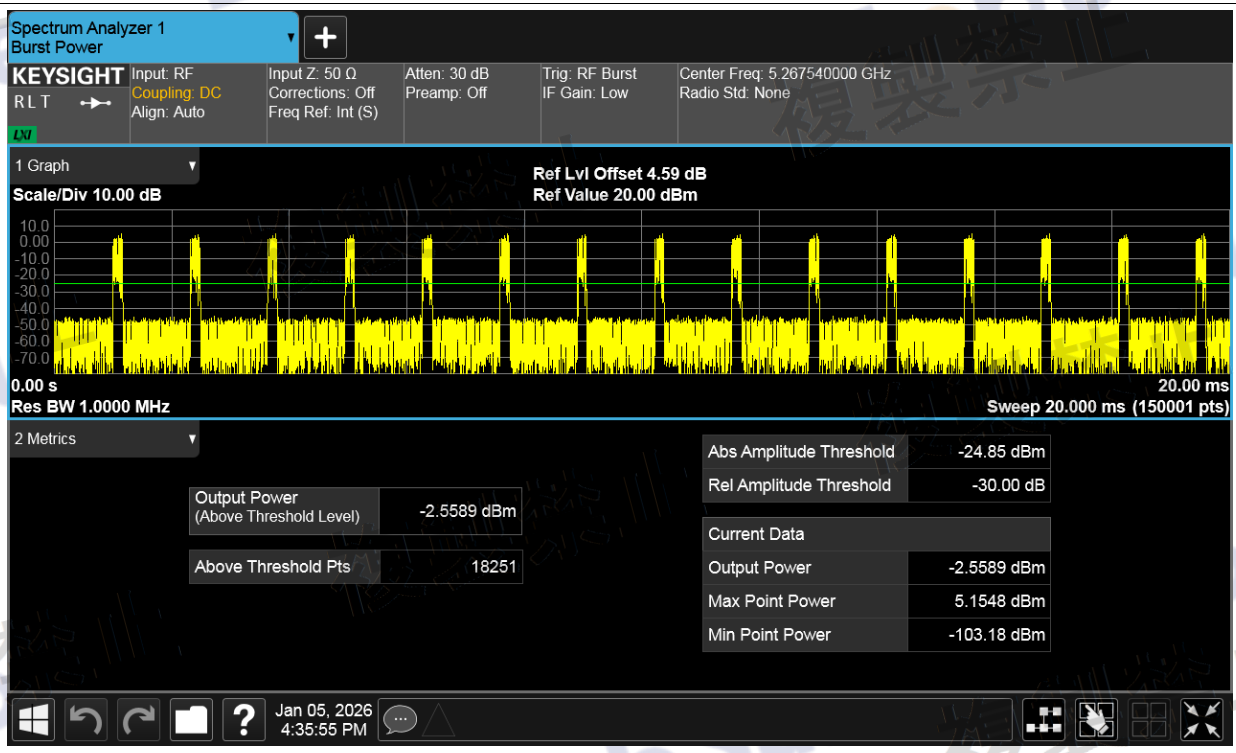


Power NVNT n40 5310MHz Ant1 Pre Scan

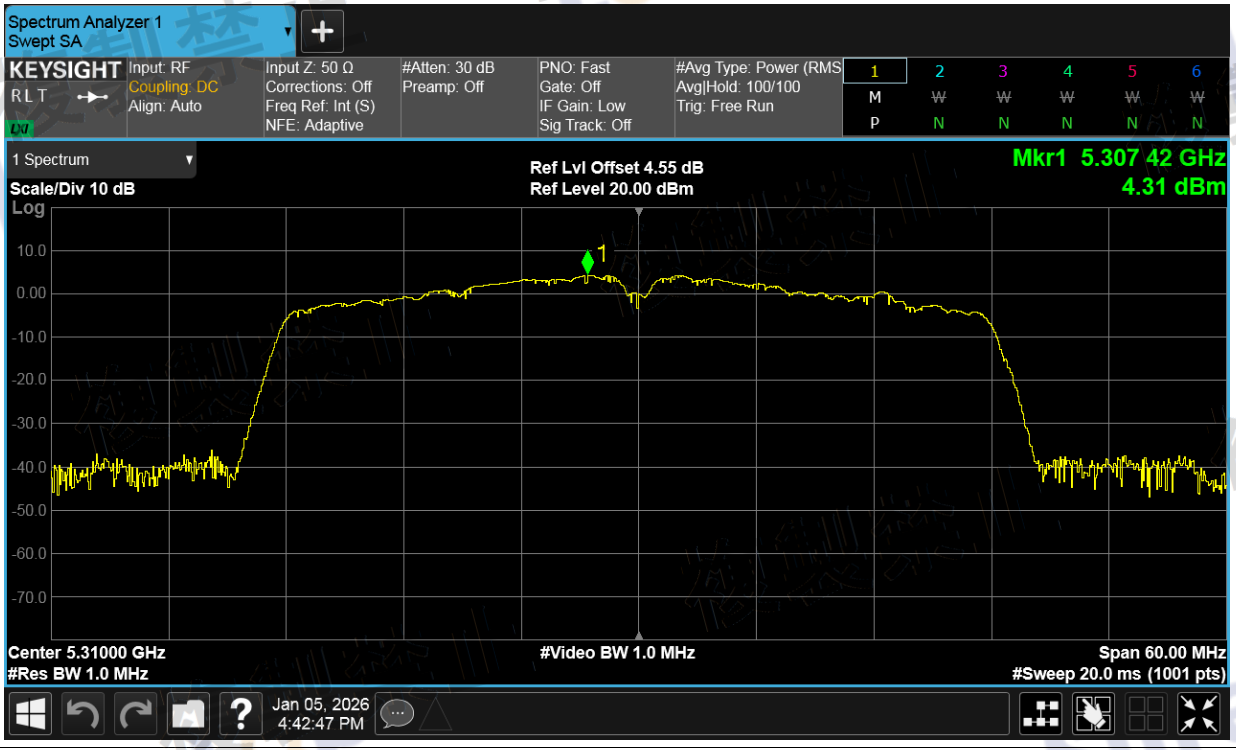


Power NVNT n40 5310MHz Ant1 Zero Span

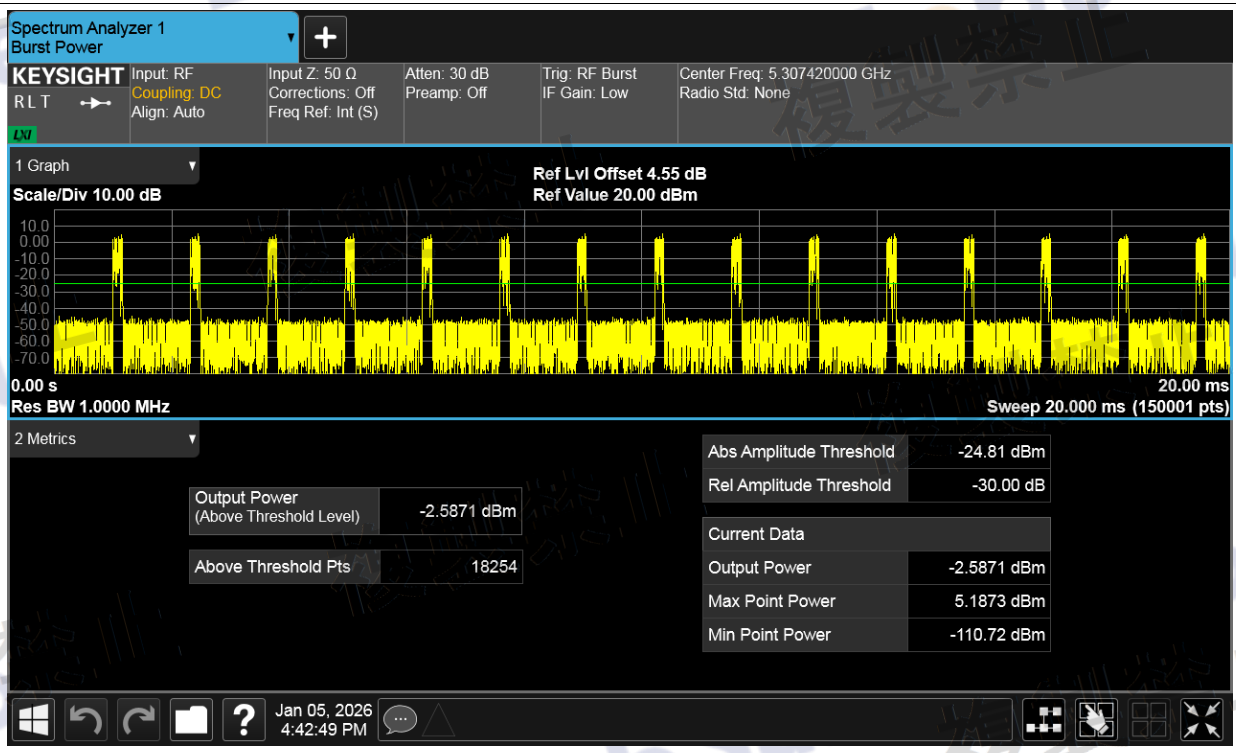


Power NVNT n40 5510MHz Ant1 Pre Scan

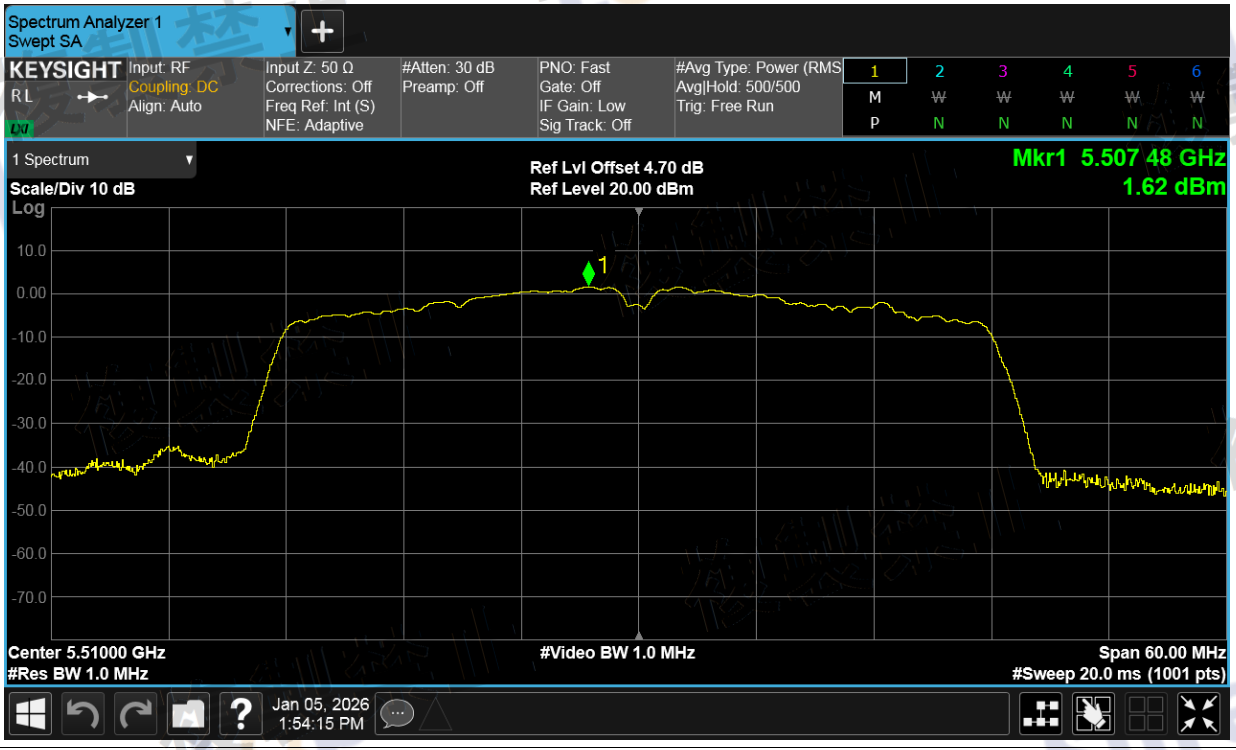


Power NVNT n40 5510MHz Ant1 Zero Span

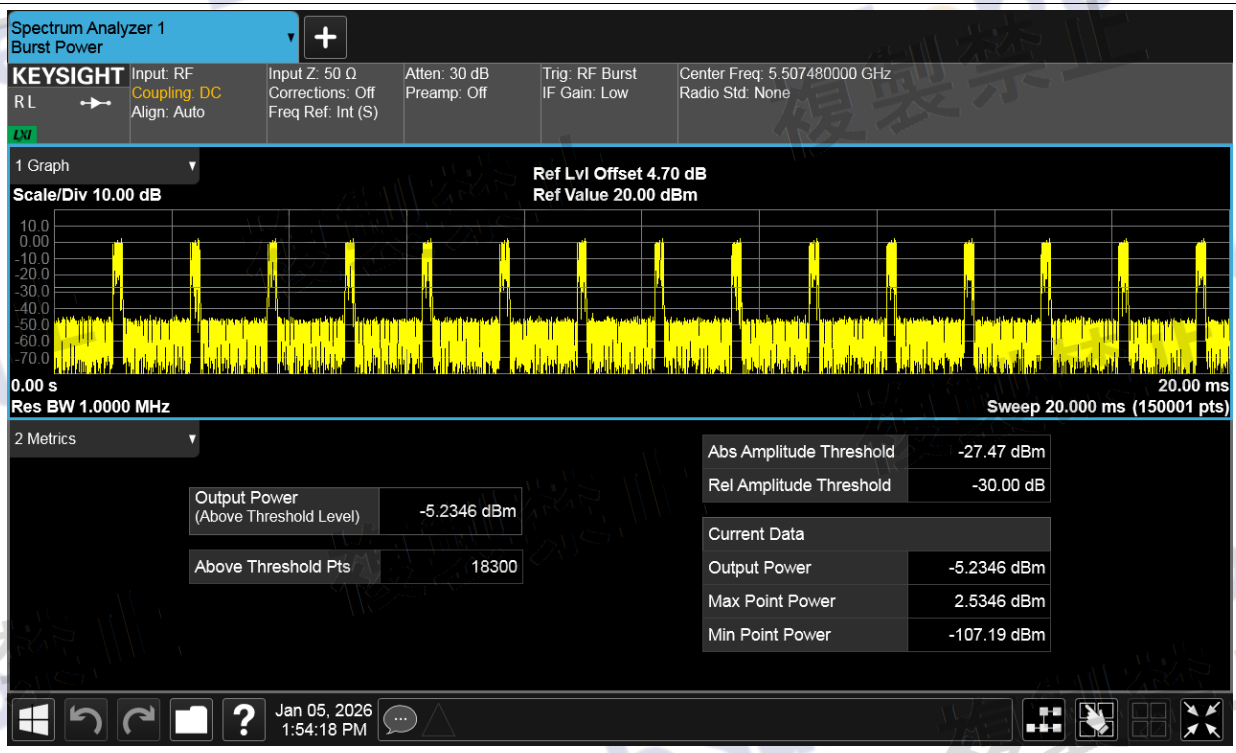


Power NVNT n40 5590MHz Ant1 Pre Scan

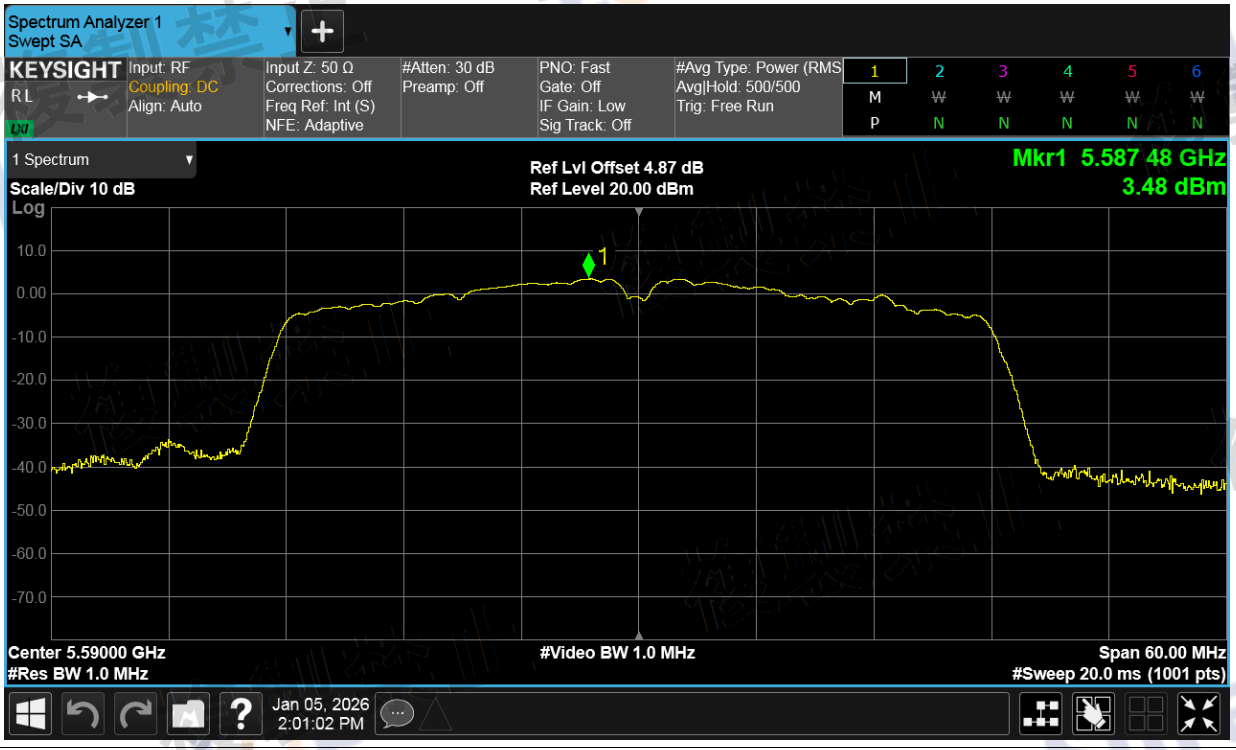


Power NVNT n40 5590MHz Ant1 Zero Span

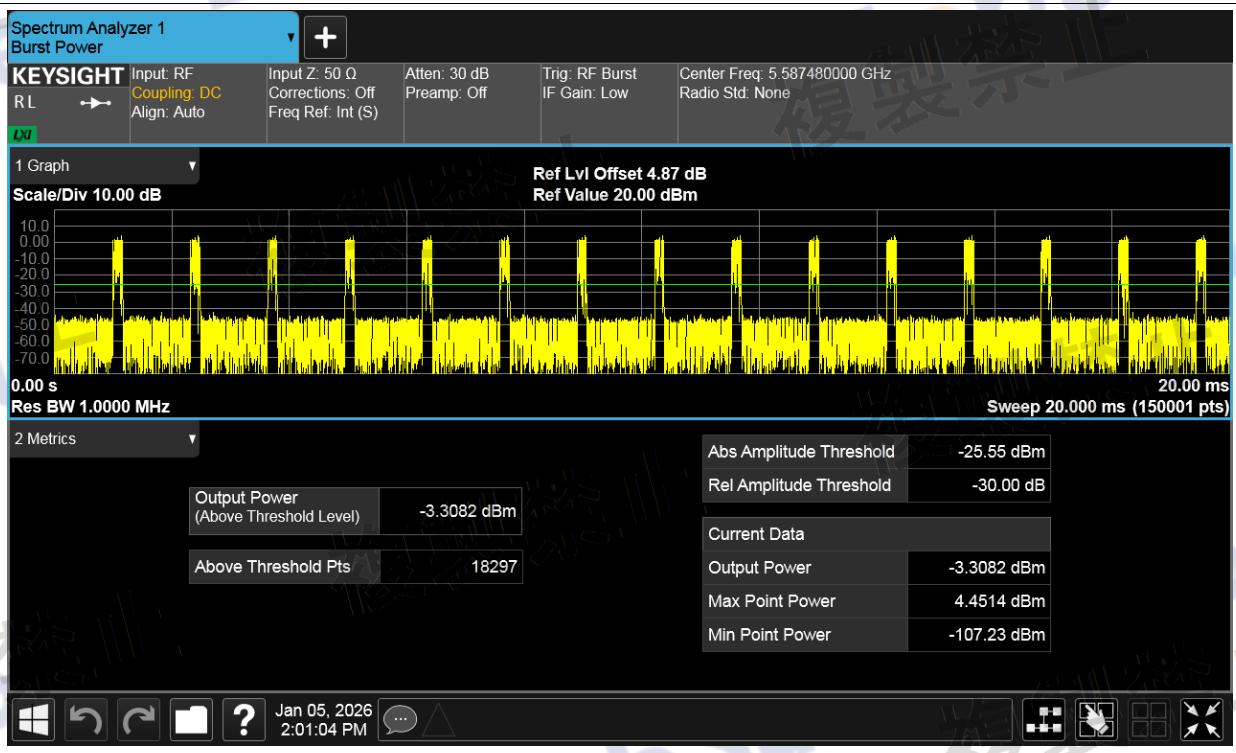


Power NVNT n40 5670MHz Ant1 Pre Scan

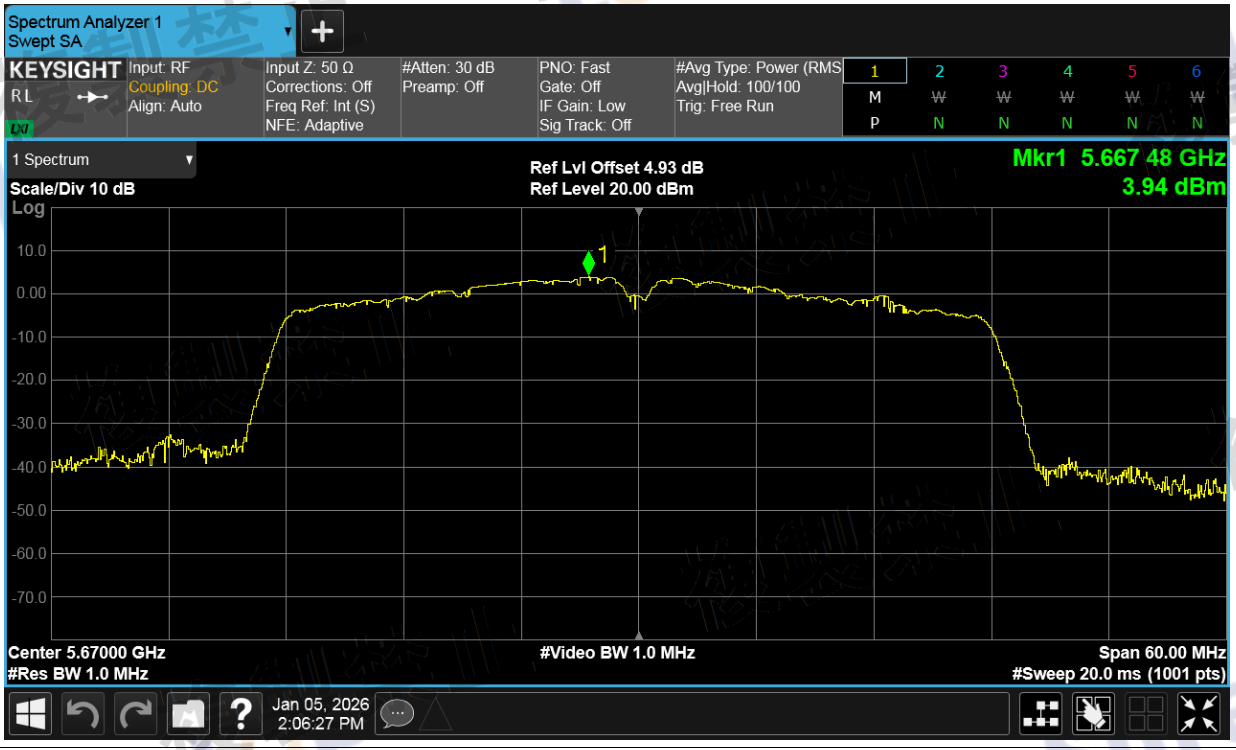


Power NVNT n40 5670MHz Ant1 Zero Span

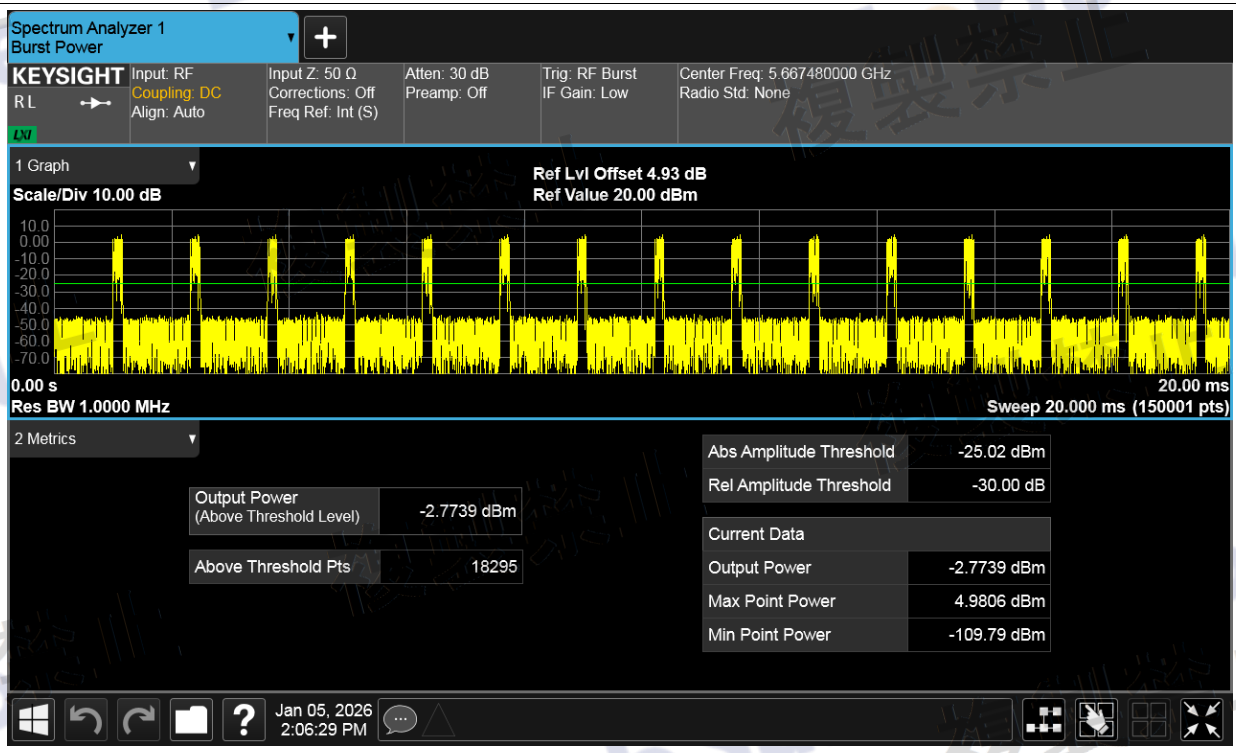


Power NVNT ac20 5180MHz Ant1 Pre Scan

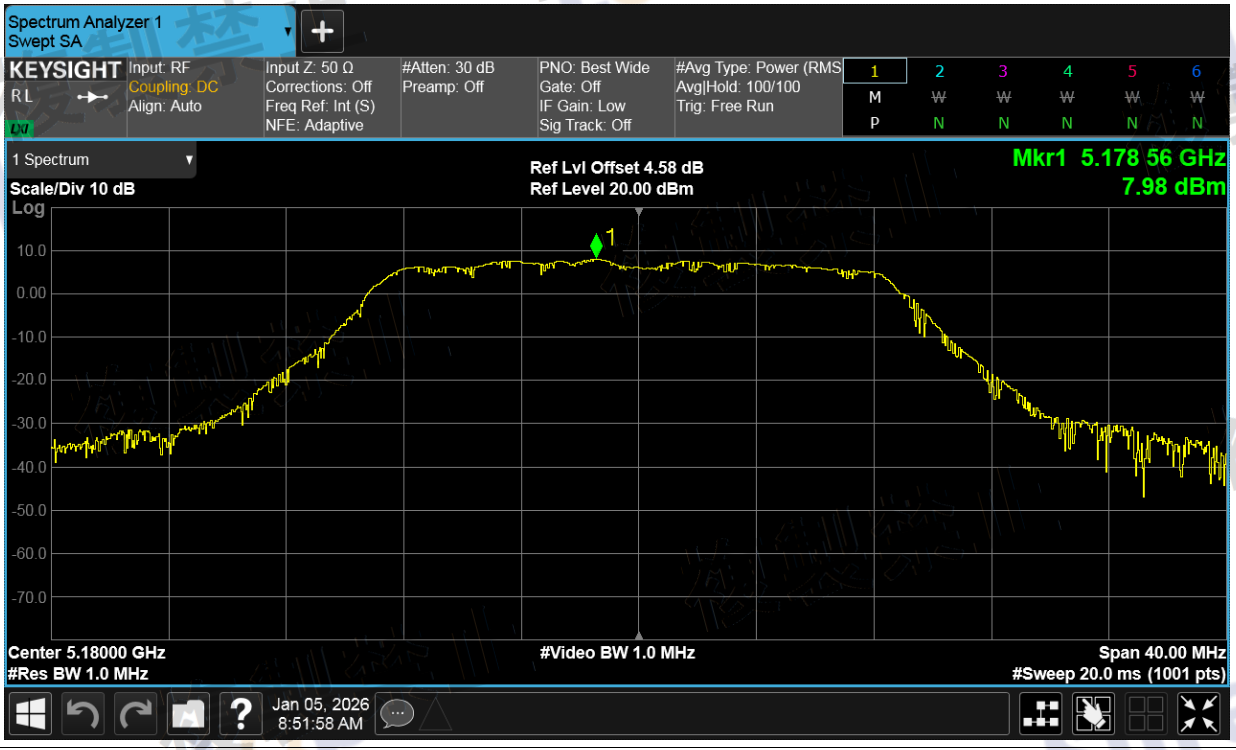


Power NVNT ac20 5180MHz Ant1 Zero Span

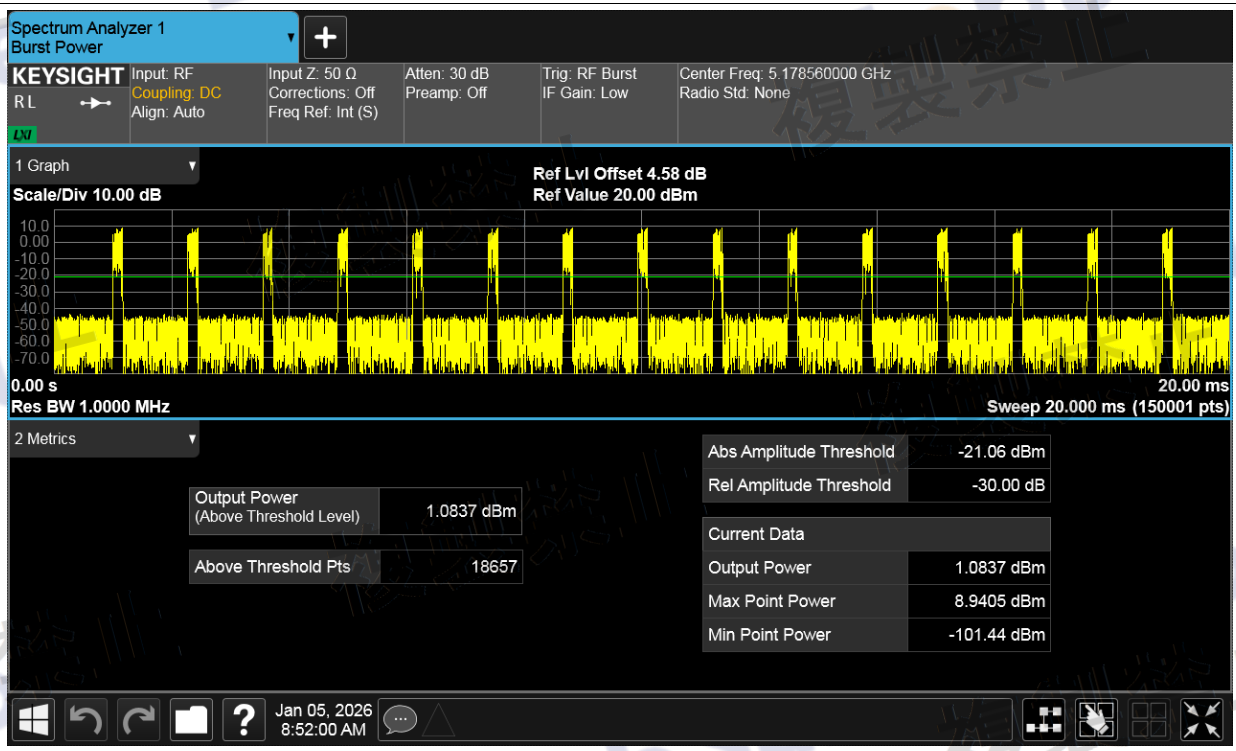


Power NVNT ac20 5200MHz Ant1 Pre Scan

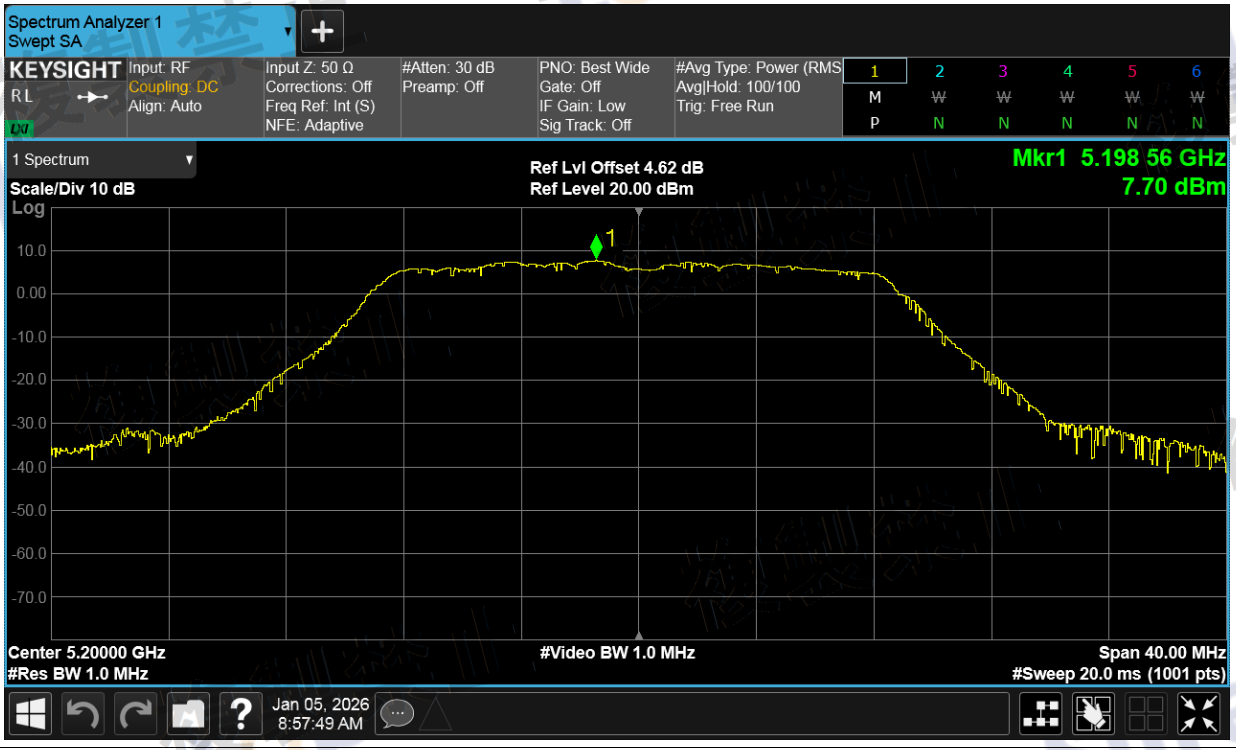


Power NVNT ac20 5200MHz Ant1 Zero Span

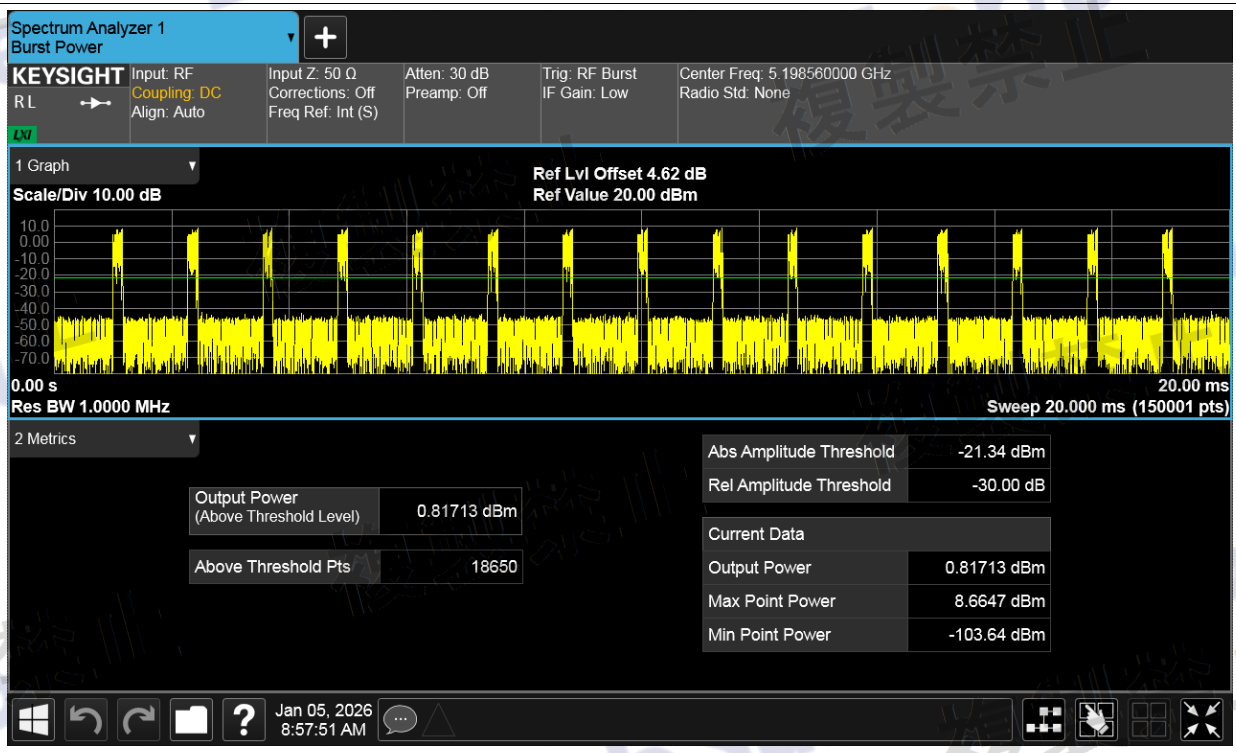


Power NVNT ac20 5240MHz Ant1 Pre Scan

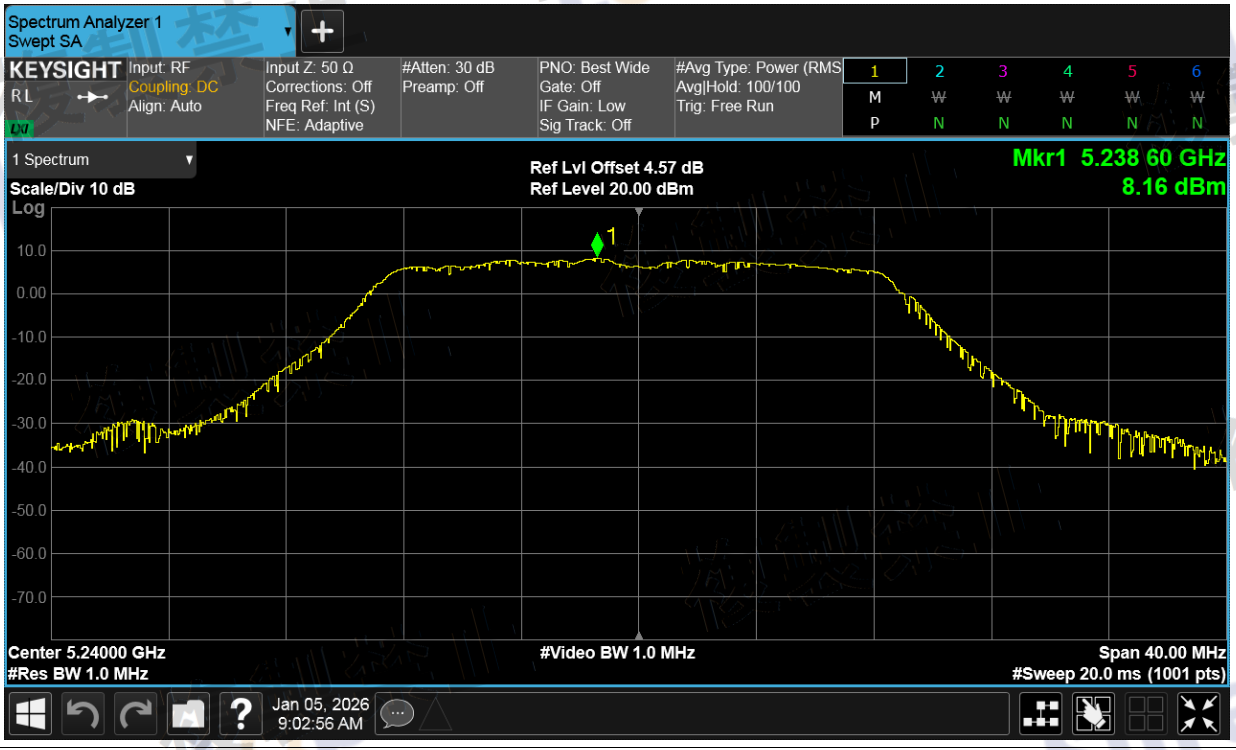


Power NVNT ac20 5240MHz Ant1 Zero Span

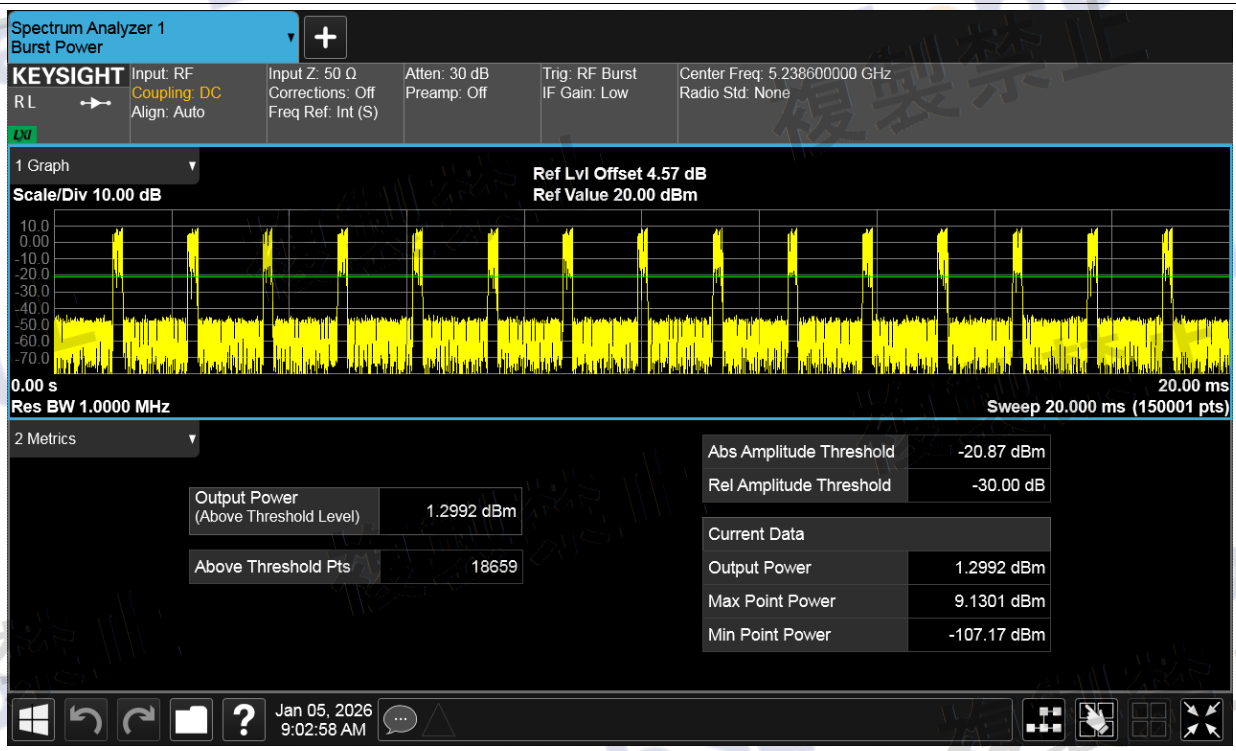


Power NVNT ac20 5260MHz Ant1 Pre Scan

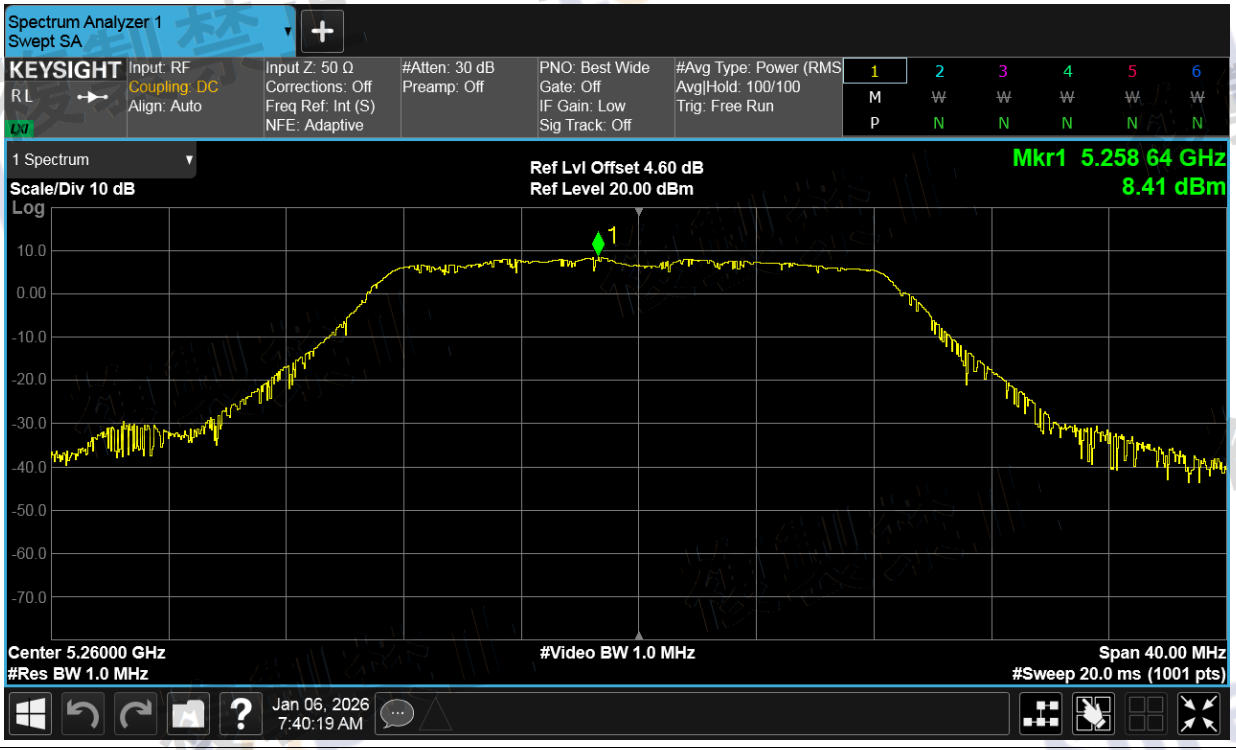

Power NVNT ac20 5260MHz Ant1 Zero Span

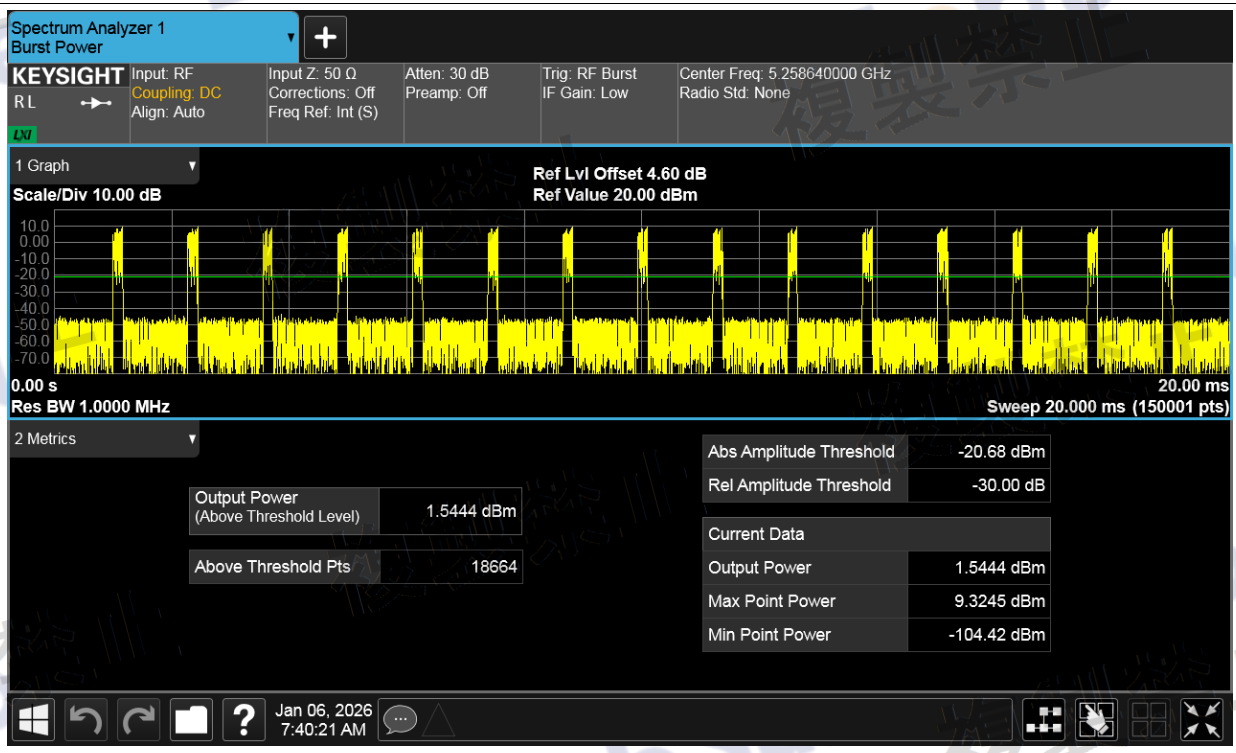


Power NVNT ac20 5300MHz Ant1 Pre Scan

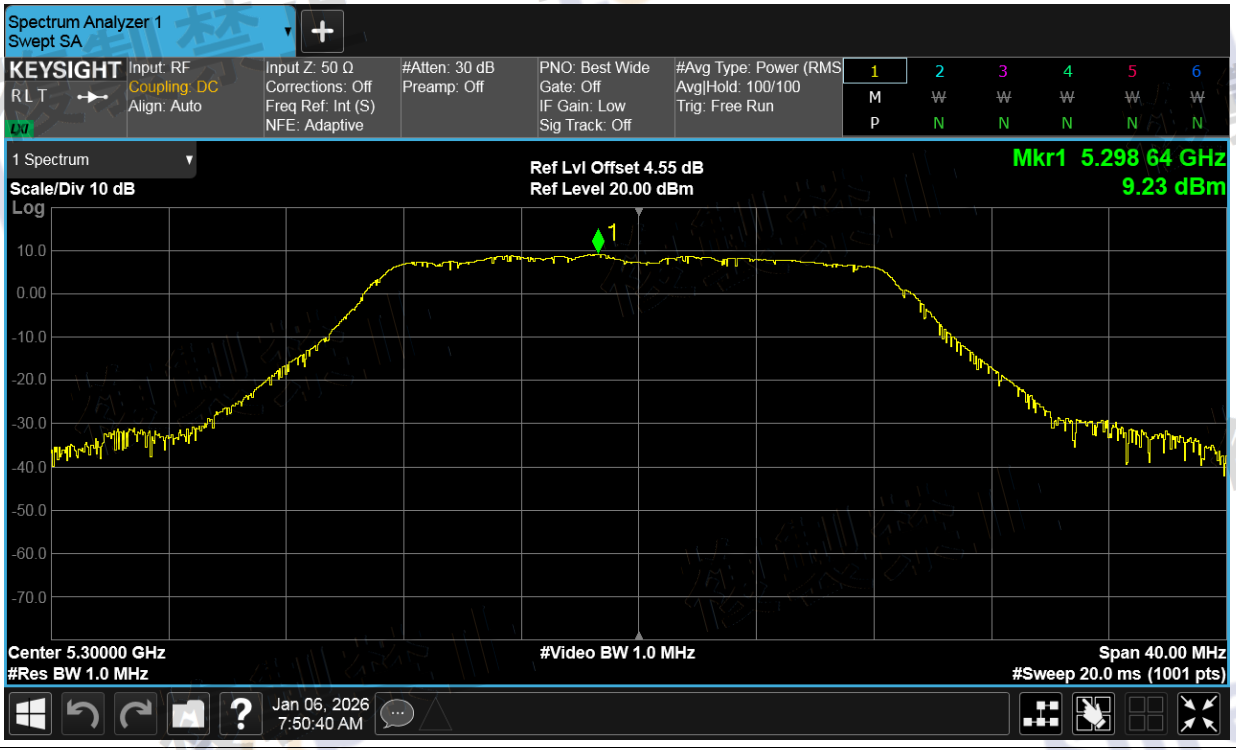


Power NVNT ac20 5300MHz Ant1 Zero Span




Power NVNT ac20 5320MHz Ant1 Pre Scan

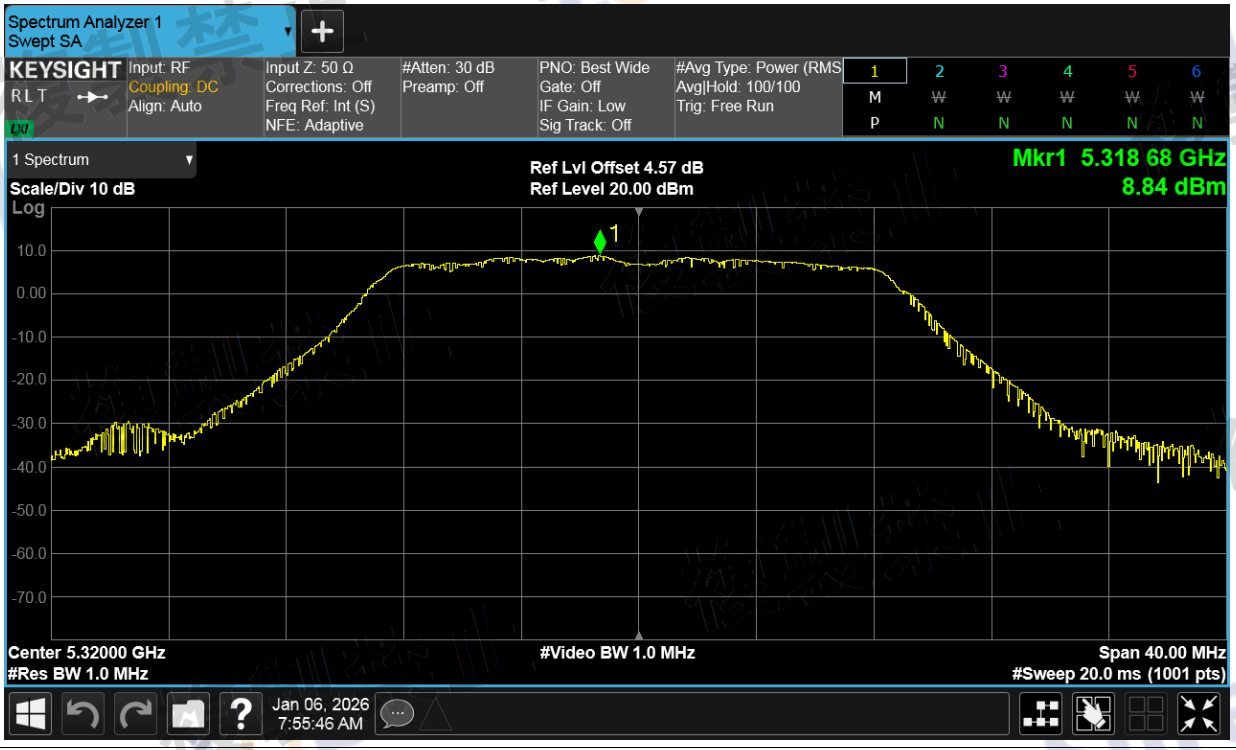


Power NVNT ac20 5320MHz Ant1 Zero Span

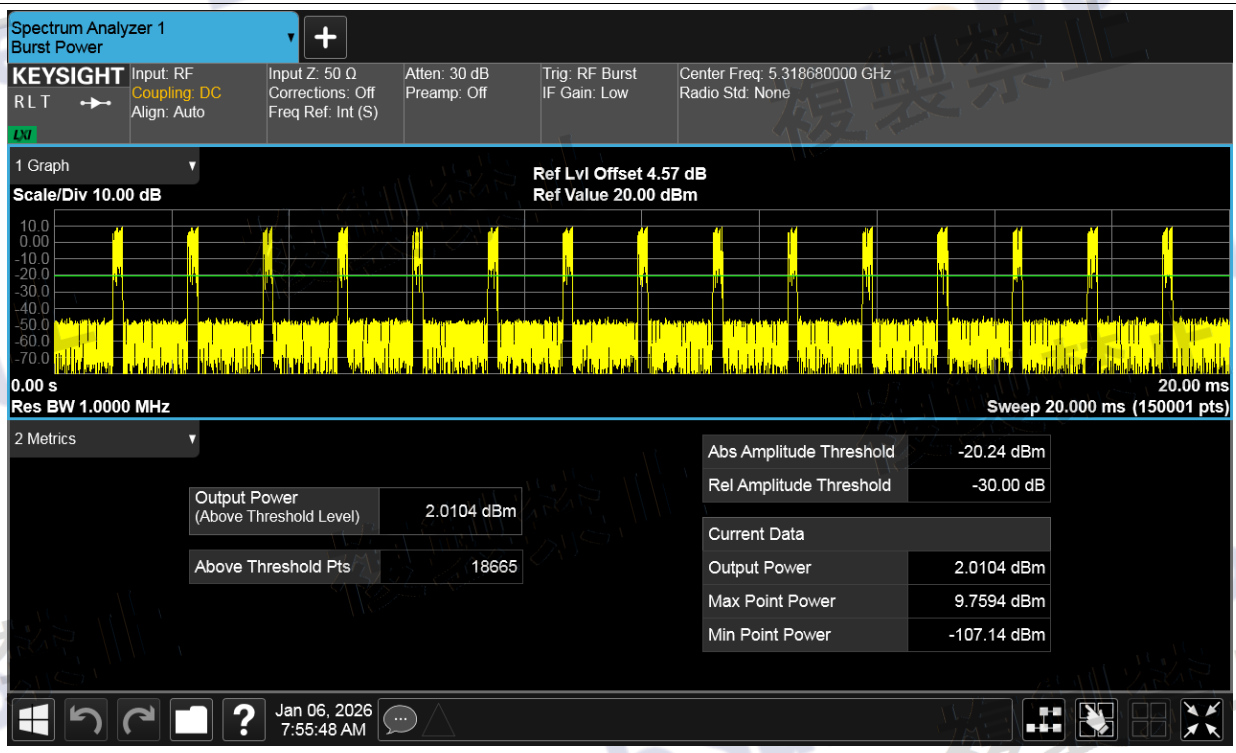


Power NVNT ac20 5500MHz Ant1 Pre Scan

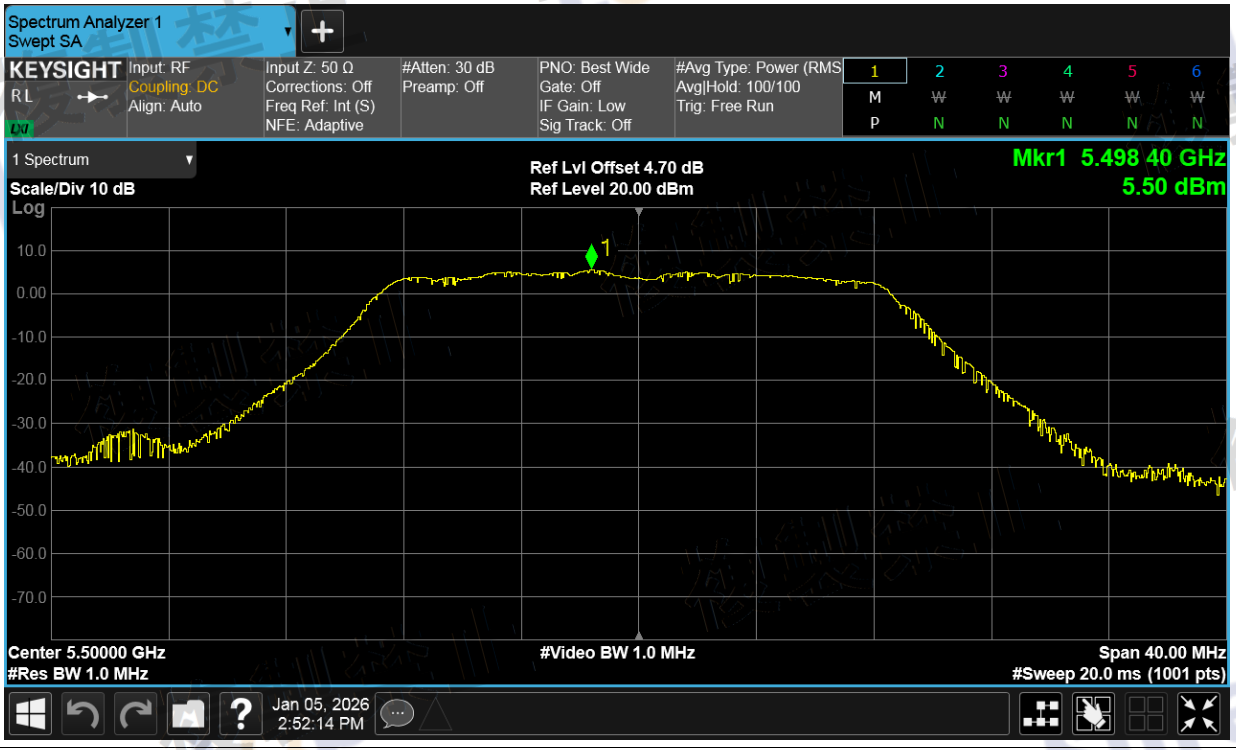


Power NVNT ac20 5500MHz Ant1 Zero Span

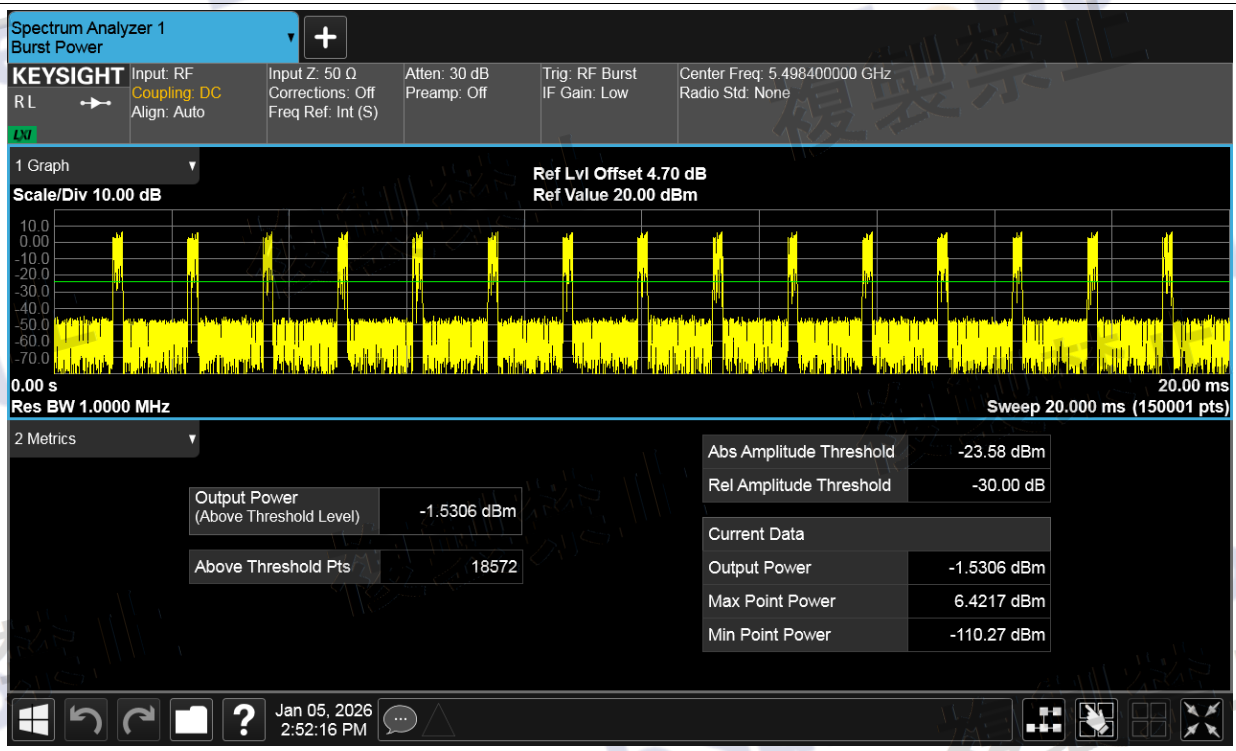


Power NVNT ac20 5580MHz Ant1 Pre Scan

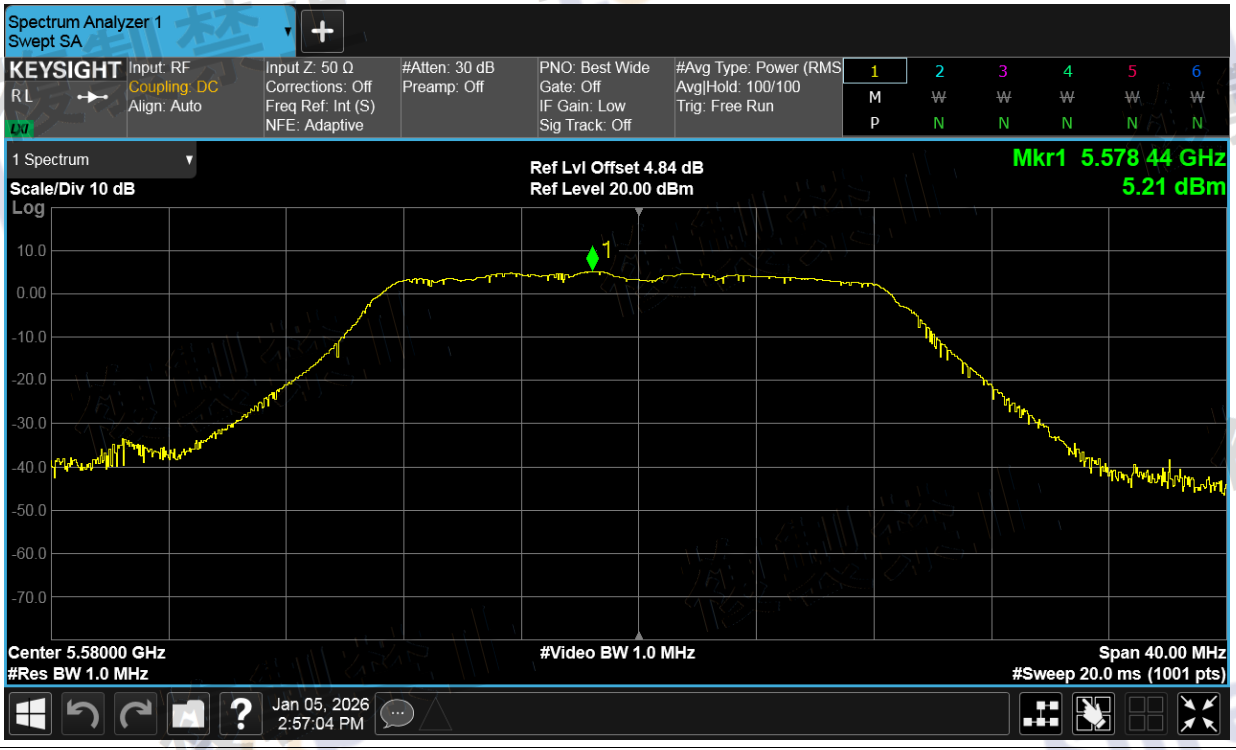


Power NVNT ac20 5580MHz Ant1 Zero Span

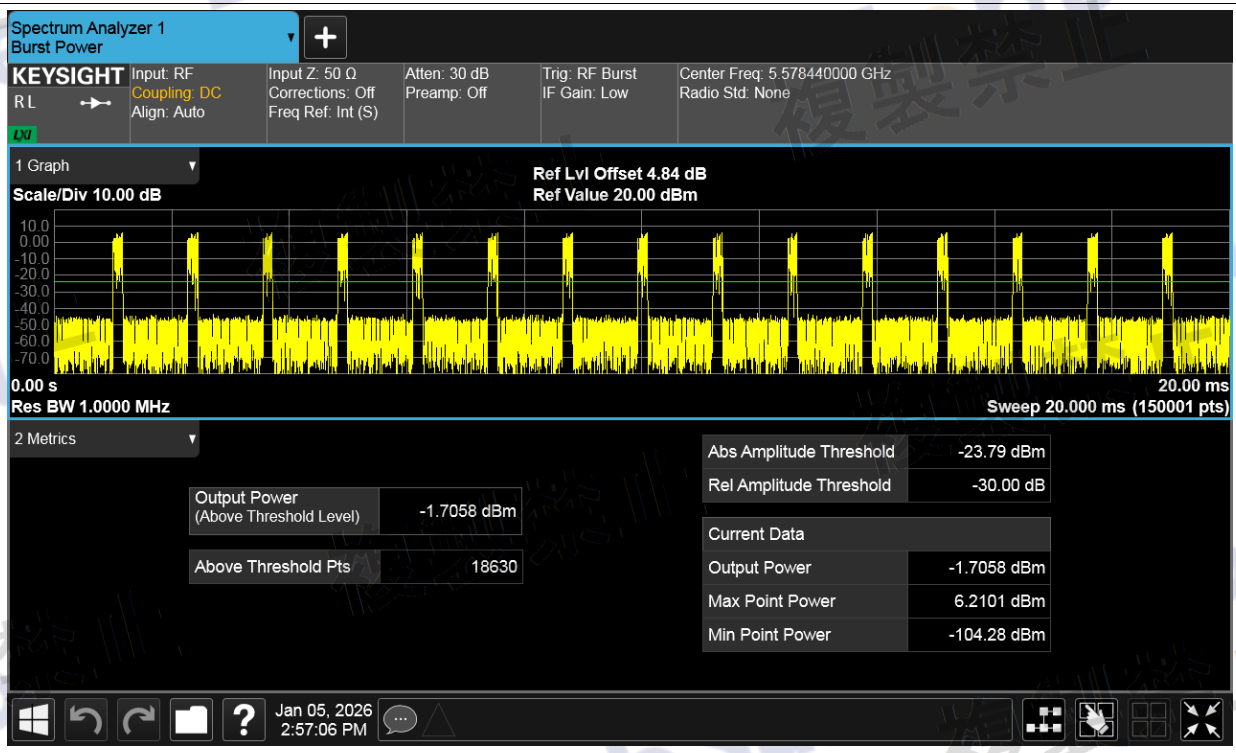


Power NVNT ac20 5700MHz Ant1 Pre Scan

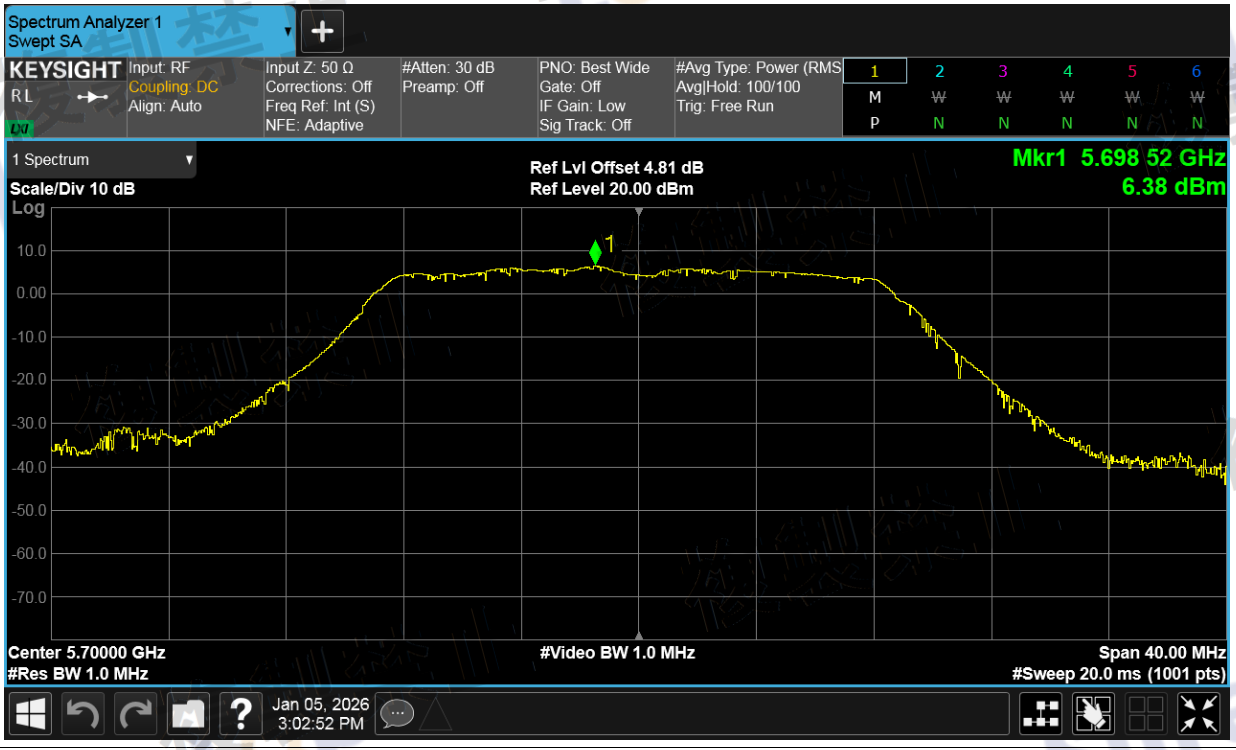


Power NVNT ac20 5700MHz Ant1 Zero Span

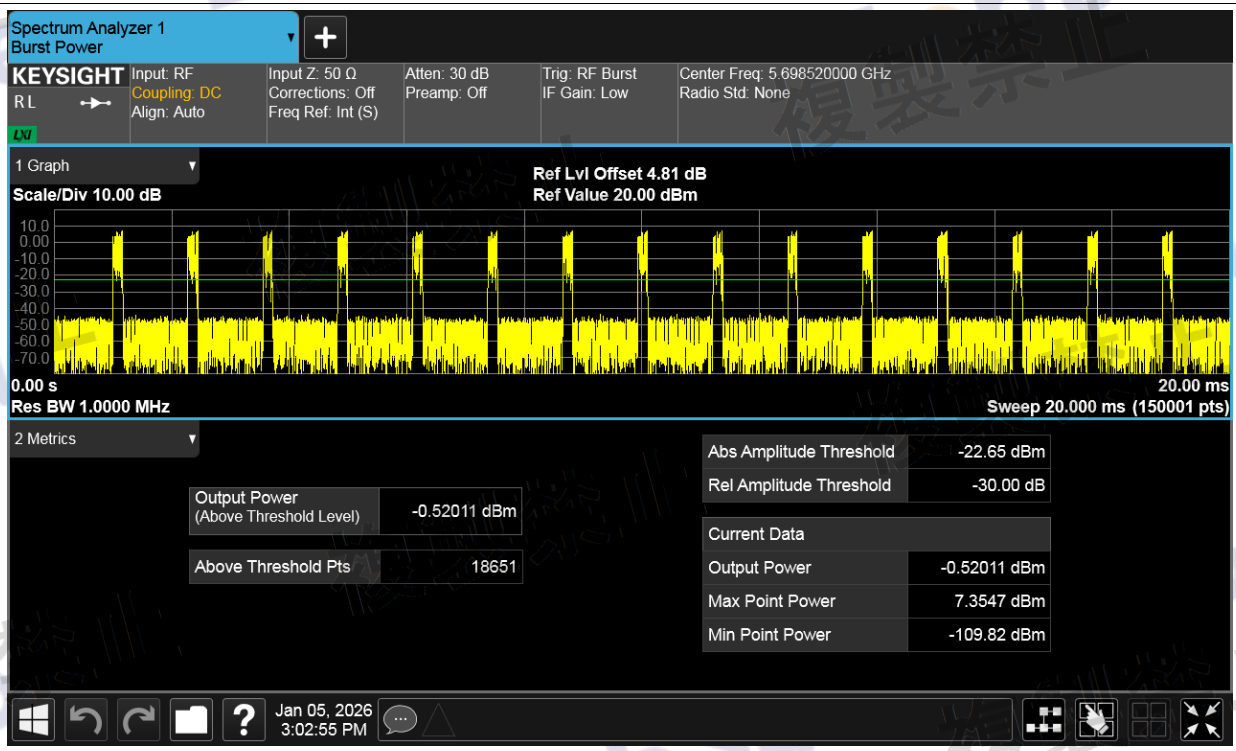


Power NVNT ac40 5190MHz Ant1 Pre Scan

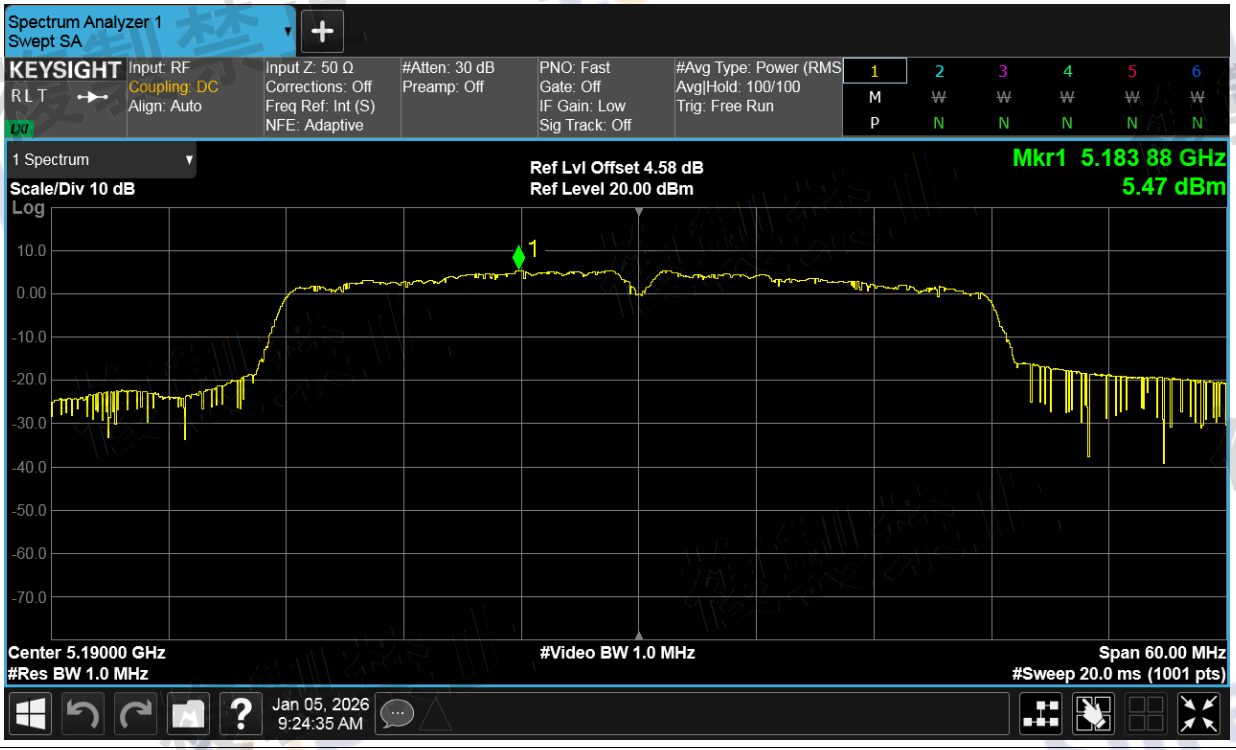


Power NVNT ac40 5190MHz Ant1 Zero Span

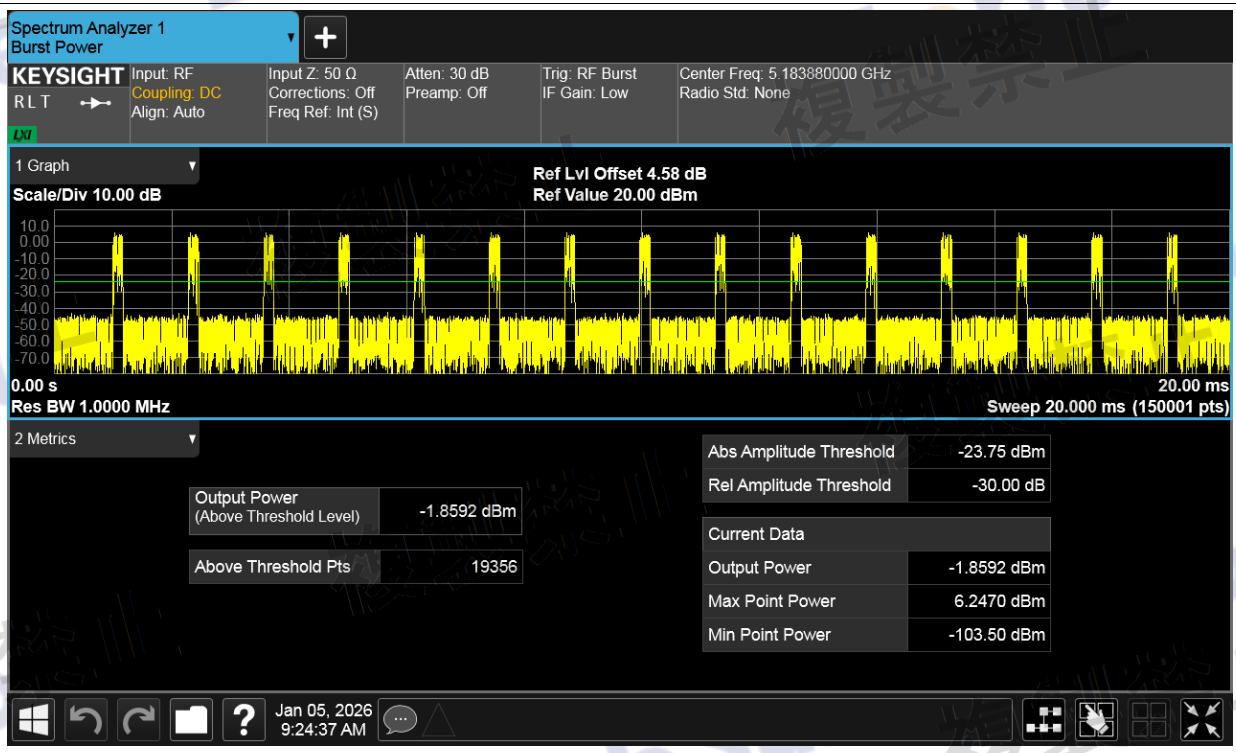


Power NVNT ac40 5200MHz Ant1 Pre Scan

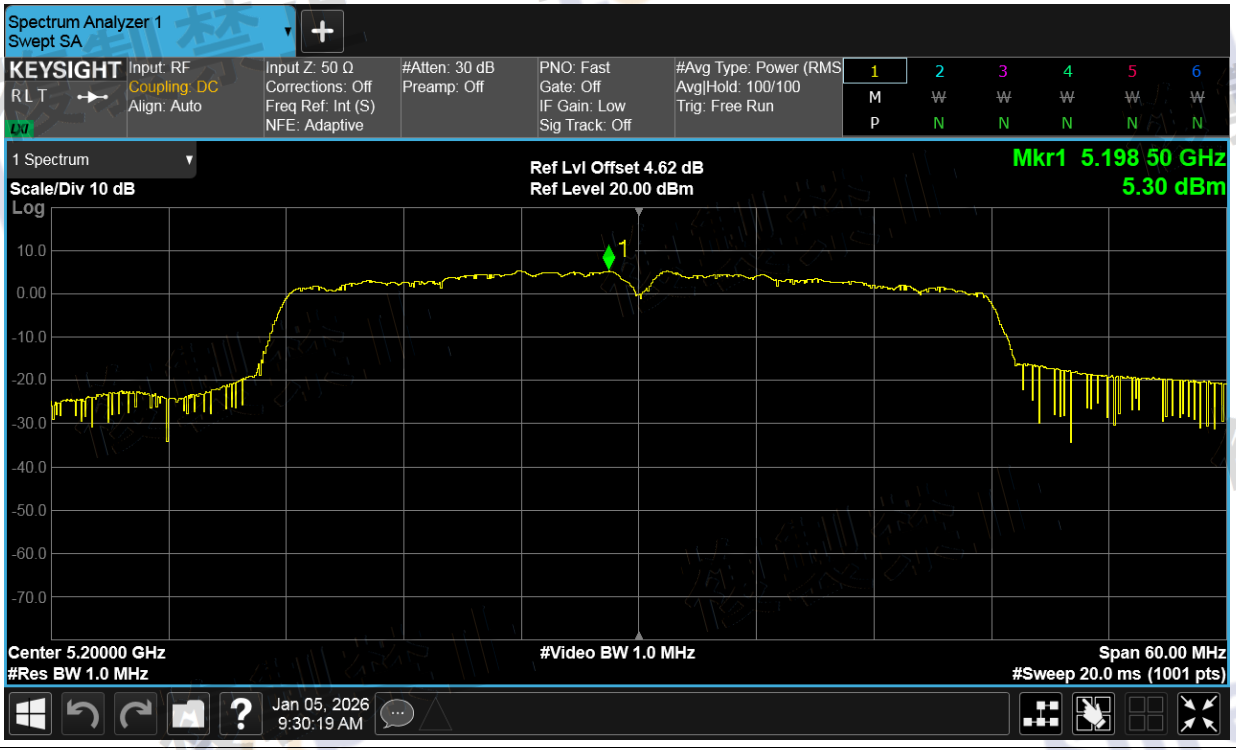


Power NVNT ac40 5200MHz Ant1 Zero Span

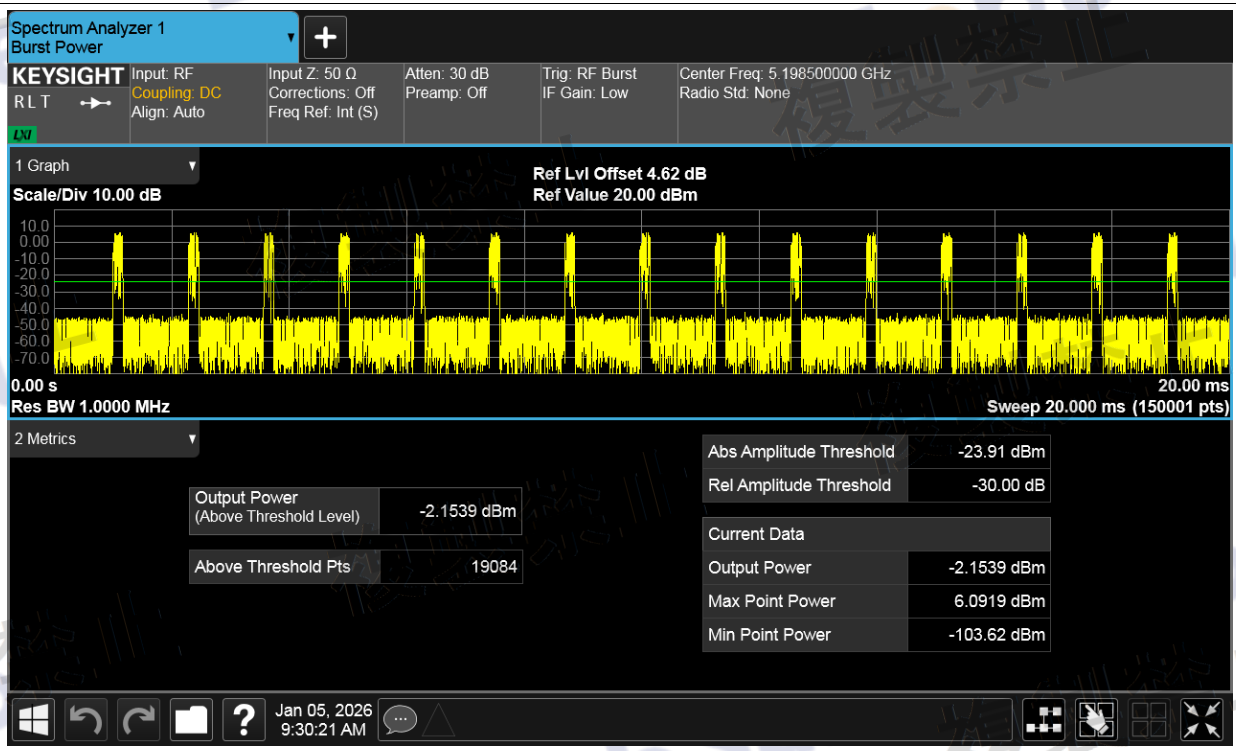


Power NVNT ac40 5230MHz Ant1 Pre Scan

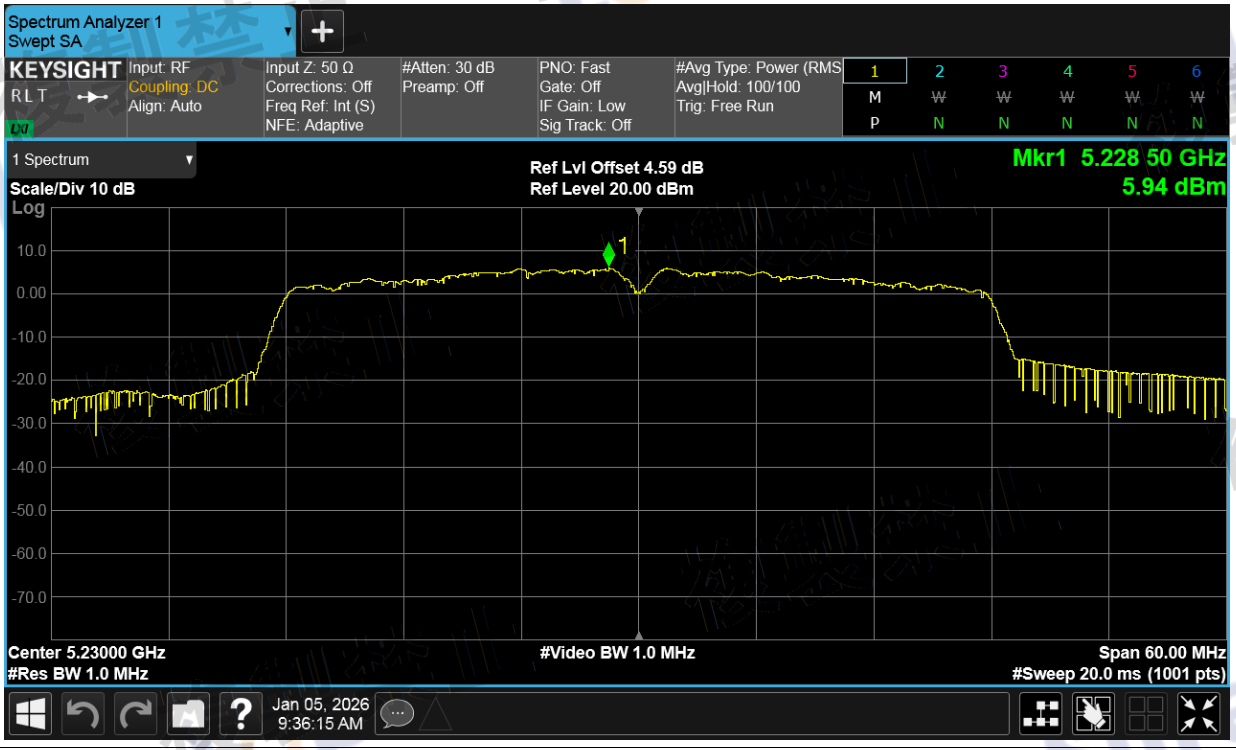


Power NVNT ac40 5230MHz Ant1 Zero Span

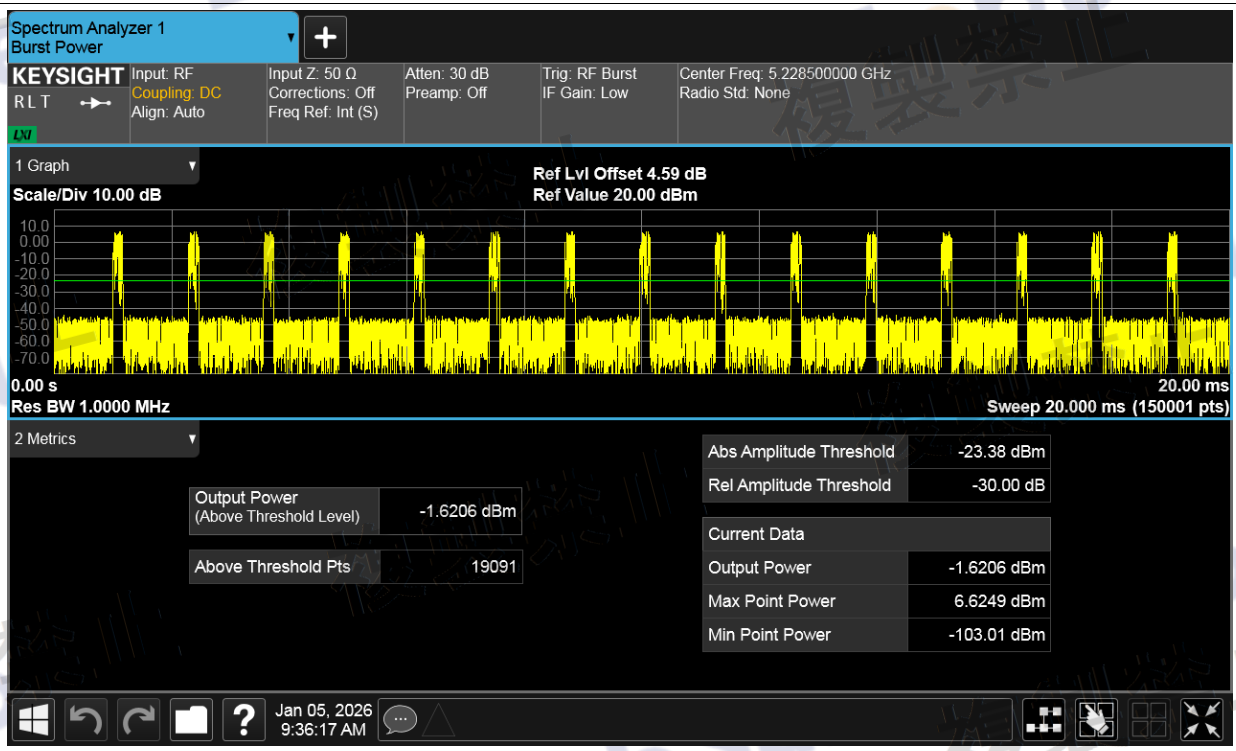


Power NVNT ac40 5270MHz Ant1 Pre Scan

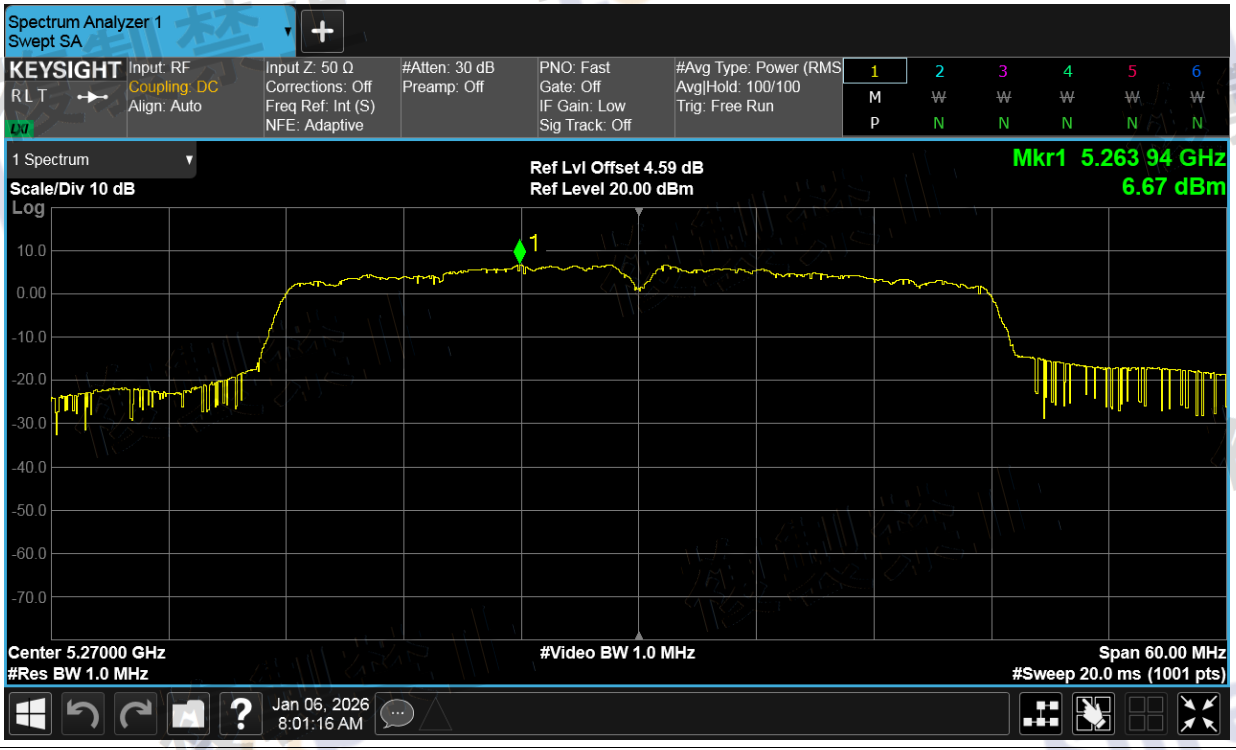


Power NVNT ac40 5270MHz Ant1 Zero Span

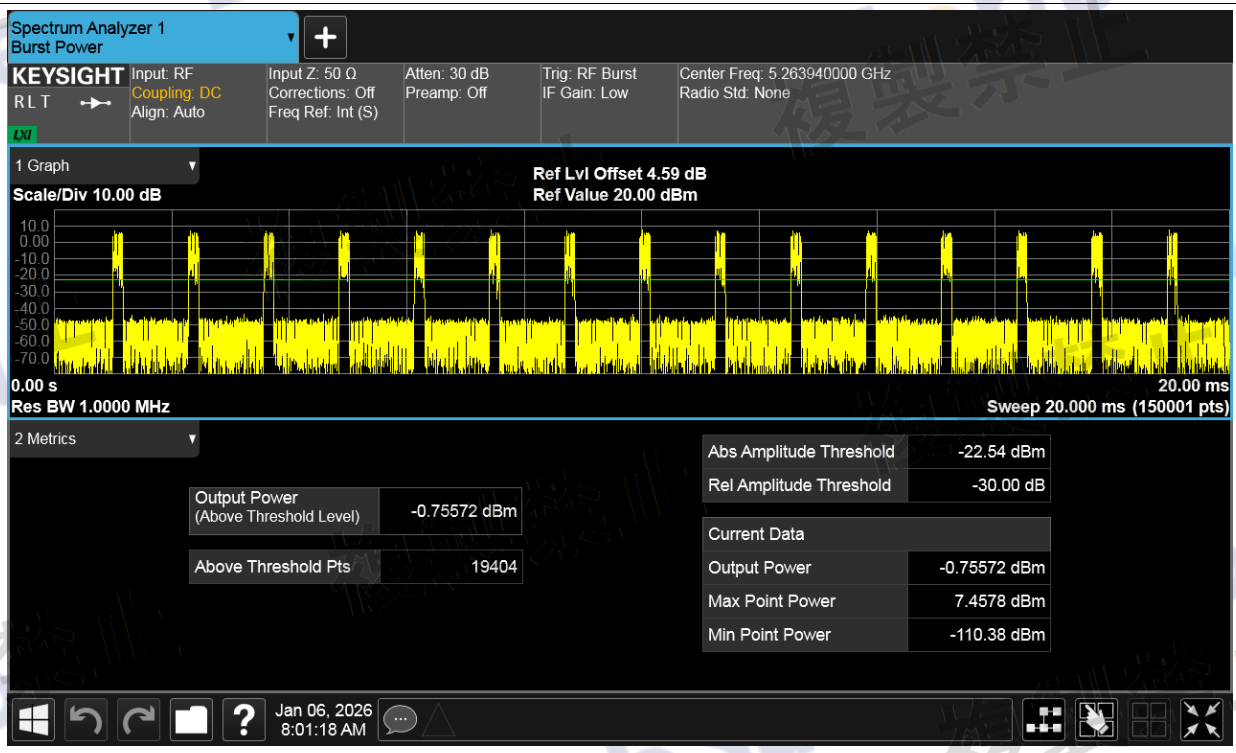


Power NVNT ac40 5310MHz Ant1 Pre Scan

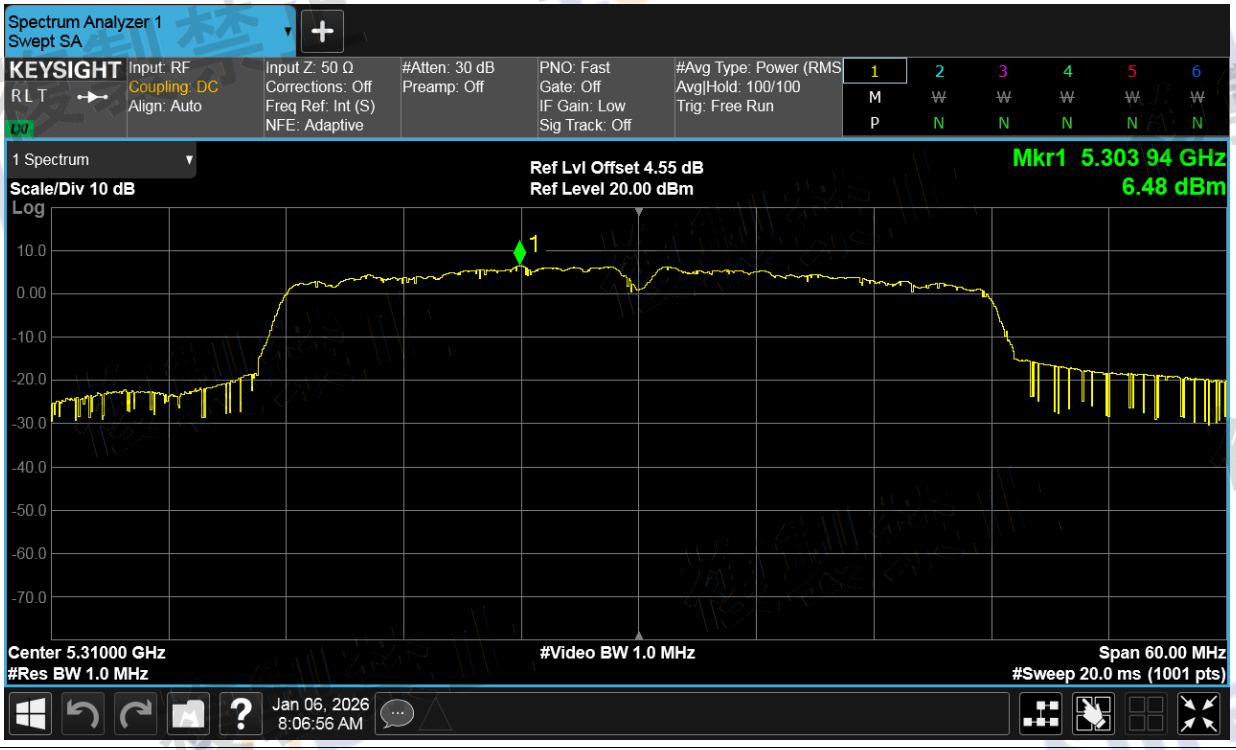


Power NVNT ac40 5310MHz Ant1 Zero Span

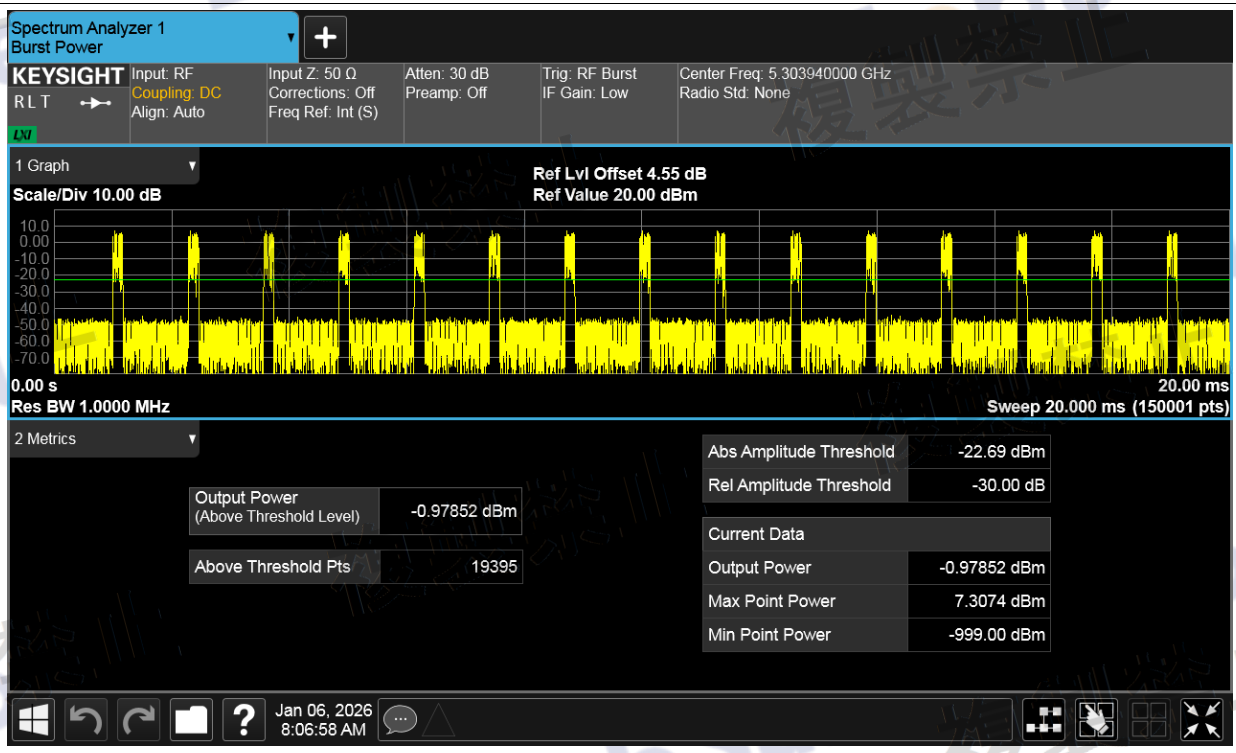


Power NVNT ac40 5510MHz Ant1 Pre Scan

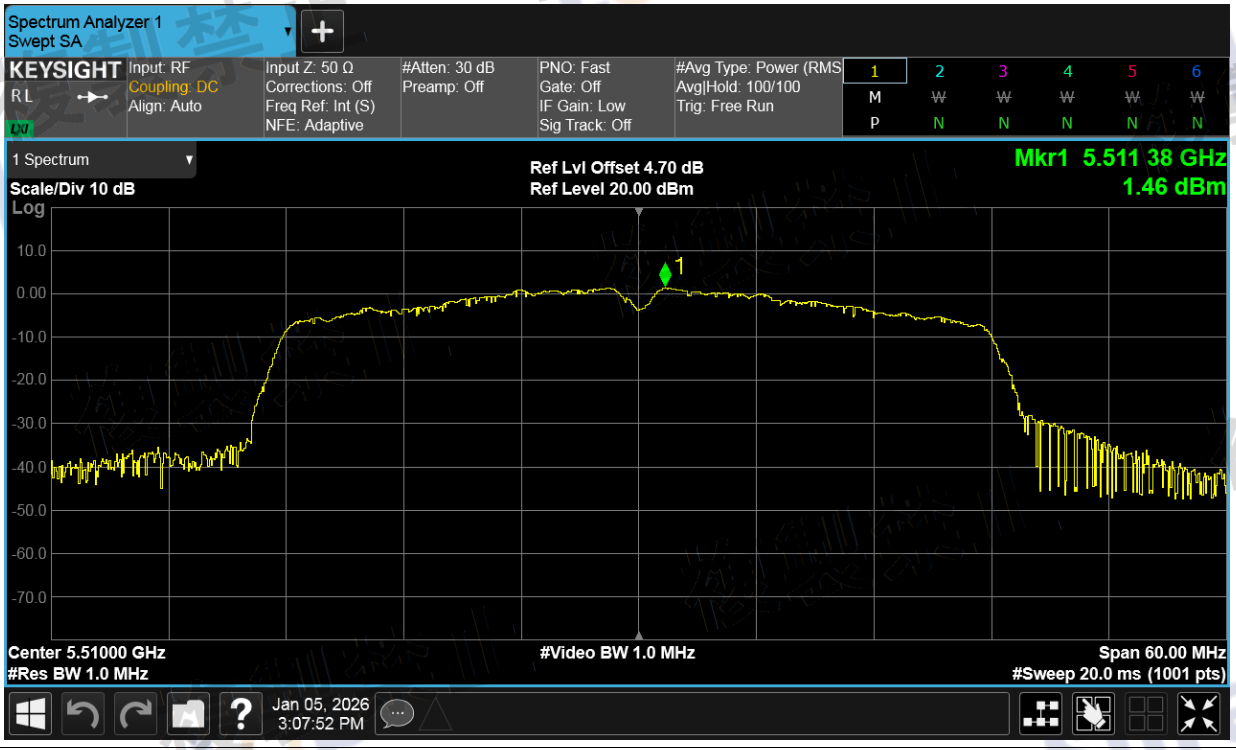


Power NVNT ac40 5510MHz Ant1 Zero Span

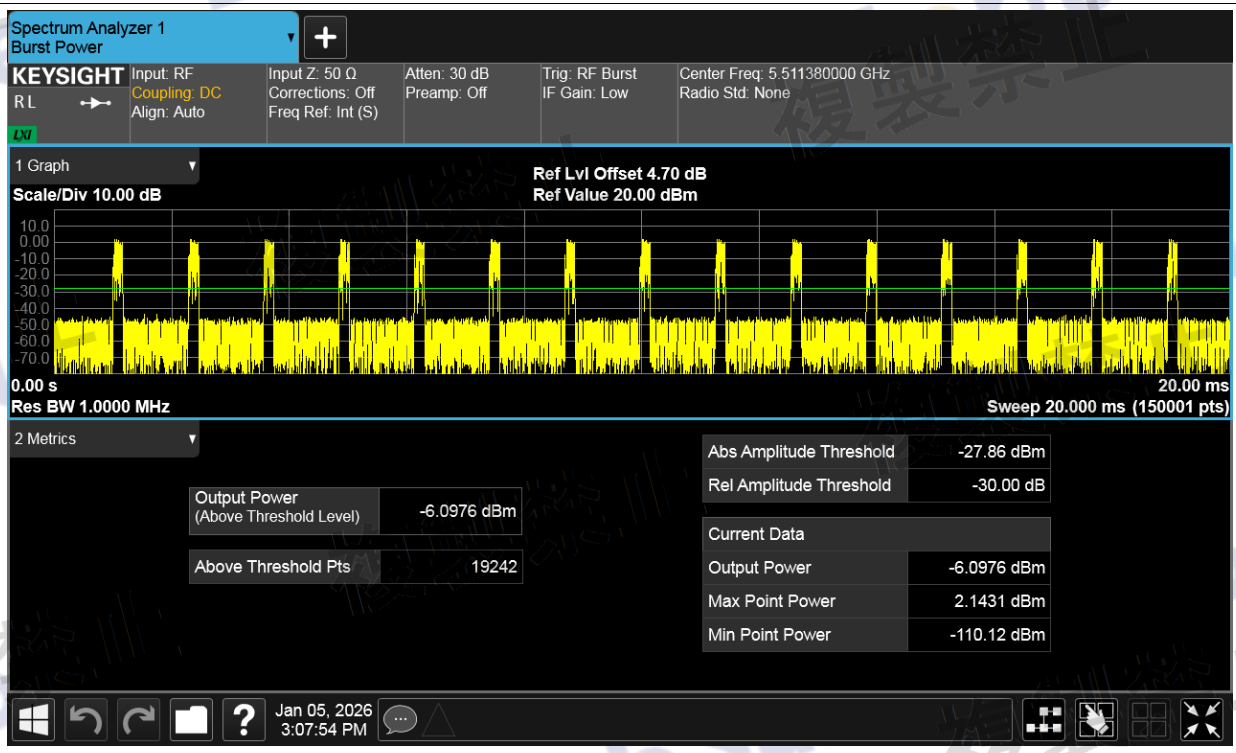


Power NVNT ac40 5590MHz Ant1 Pre Scan

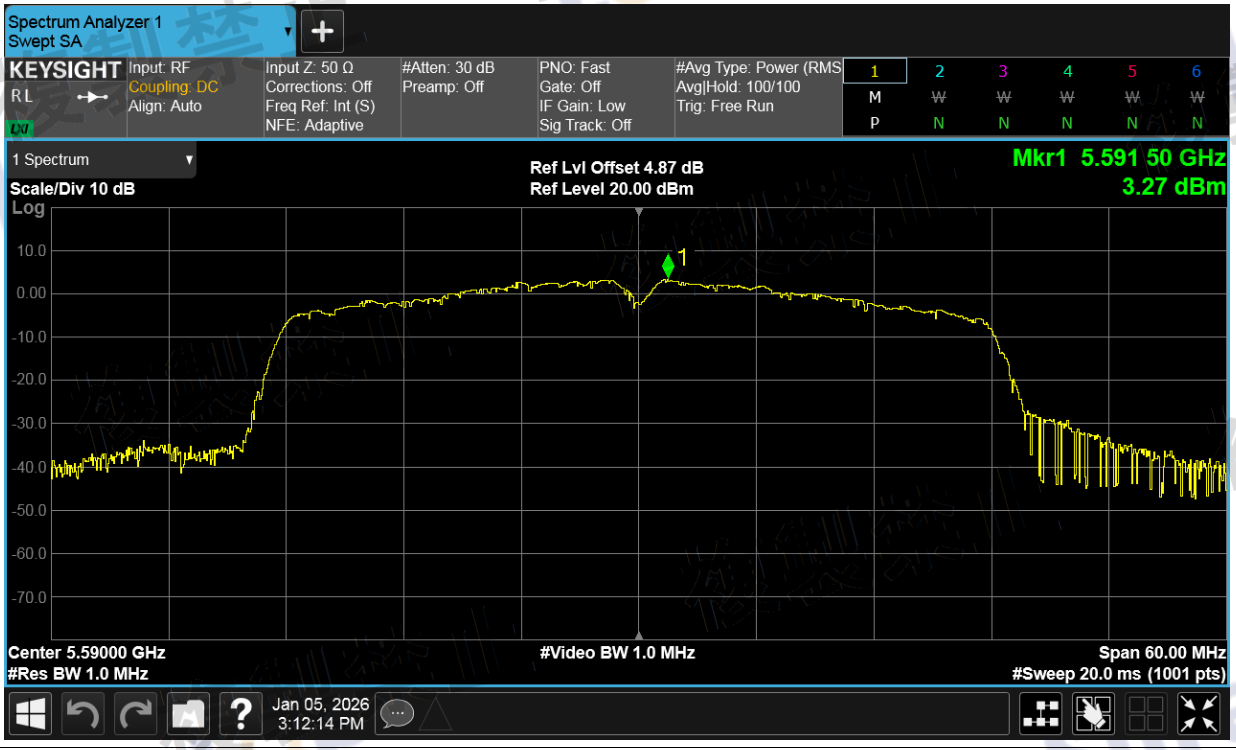


Power NVNT ac40 5590MHz Ant1 Zero Span

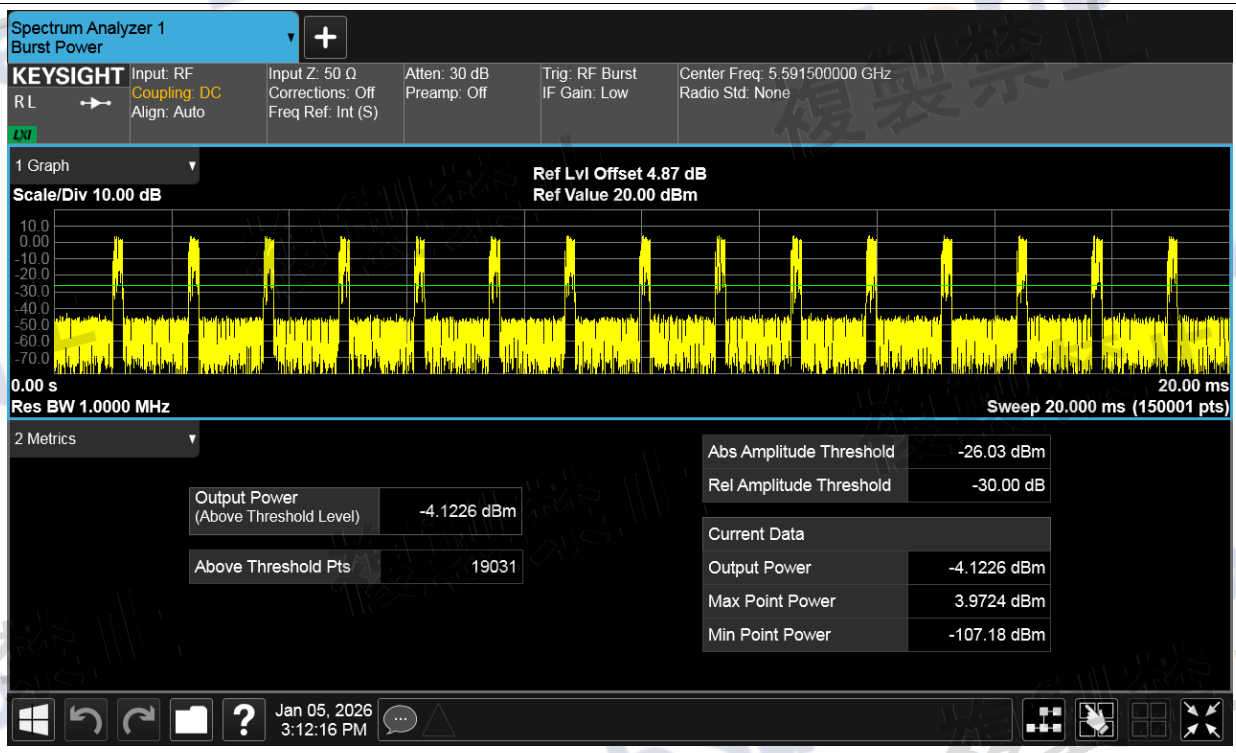


Power NVNT ac40 5670MHz Ant1 Pre Scan

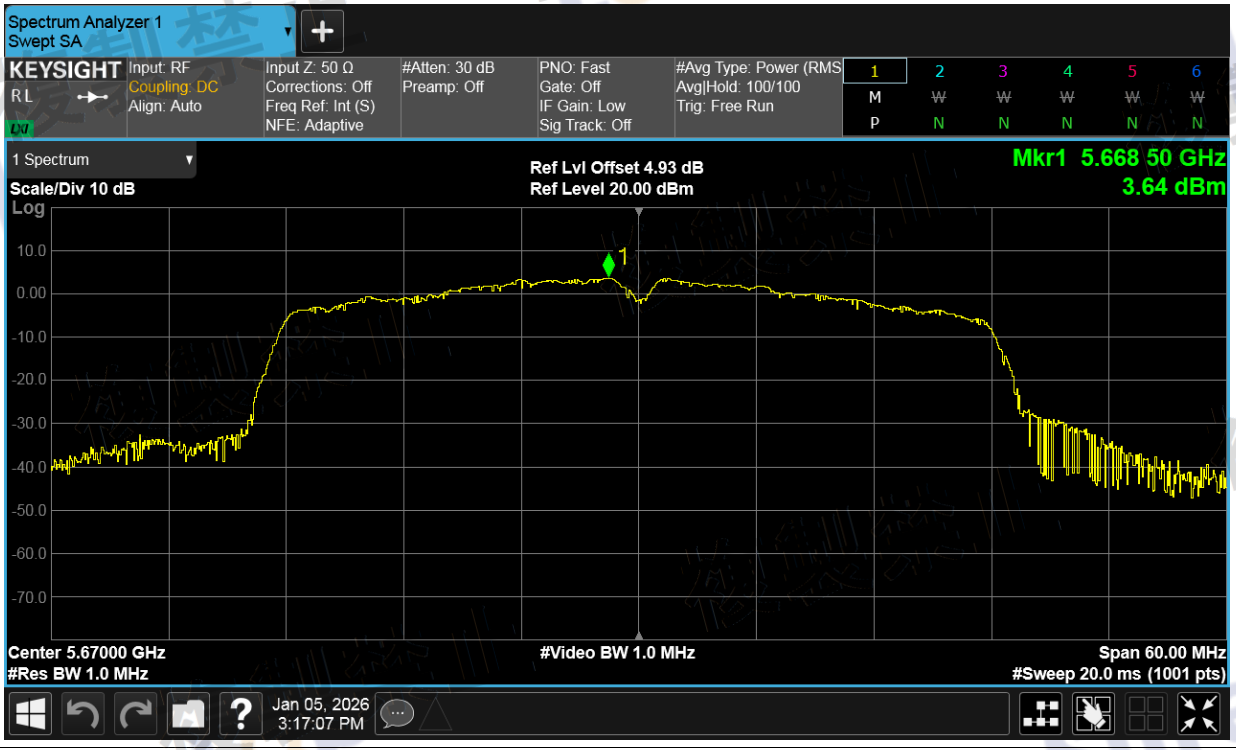

Power NVNT ac40 5670MHz Ant1 Zero Span

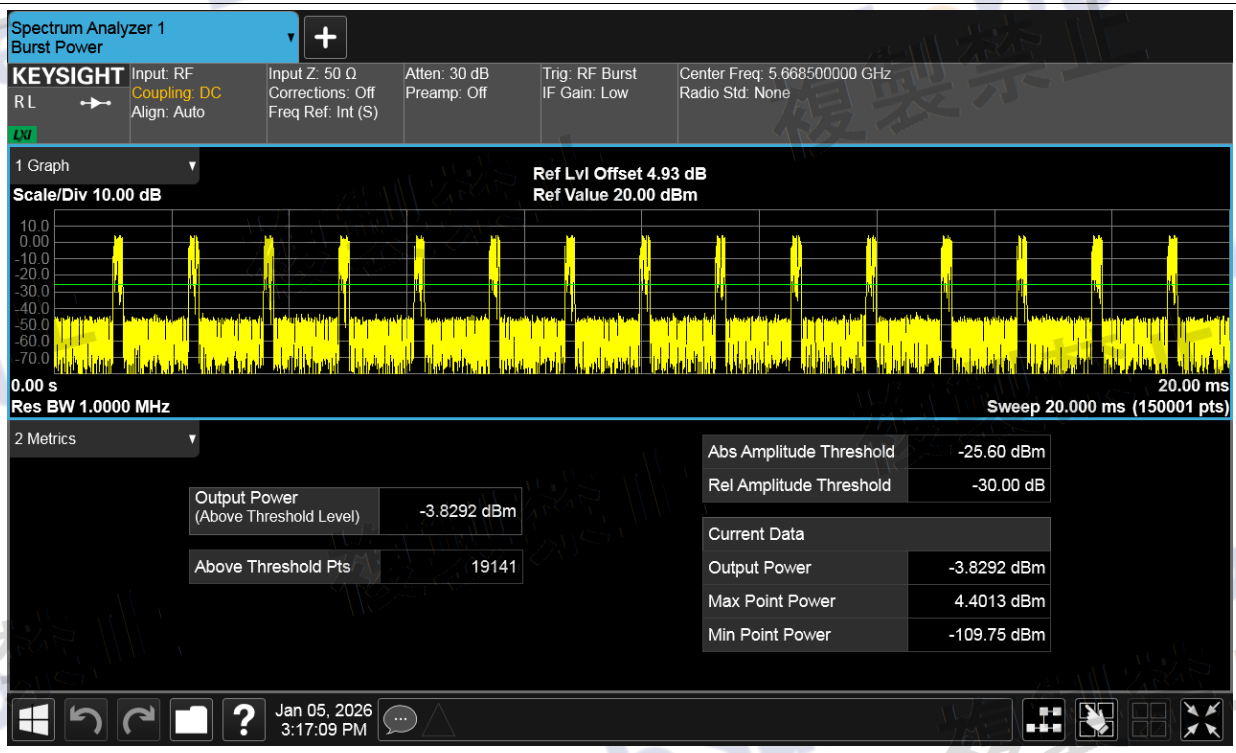


Power NVNT ax20 5180MHz Ant1 Pre Scan

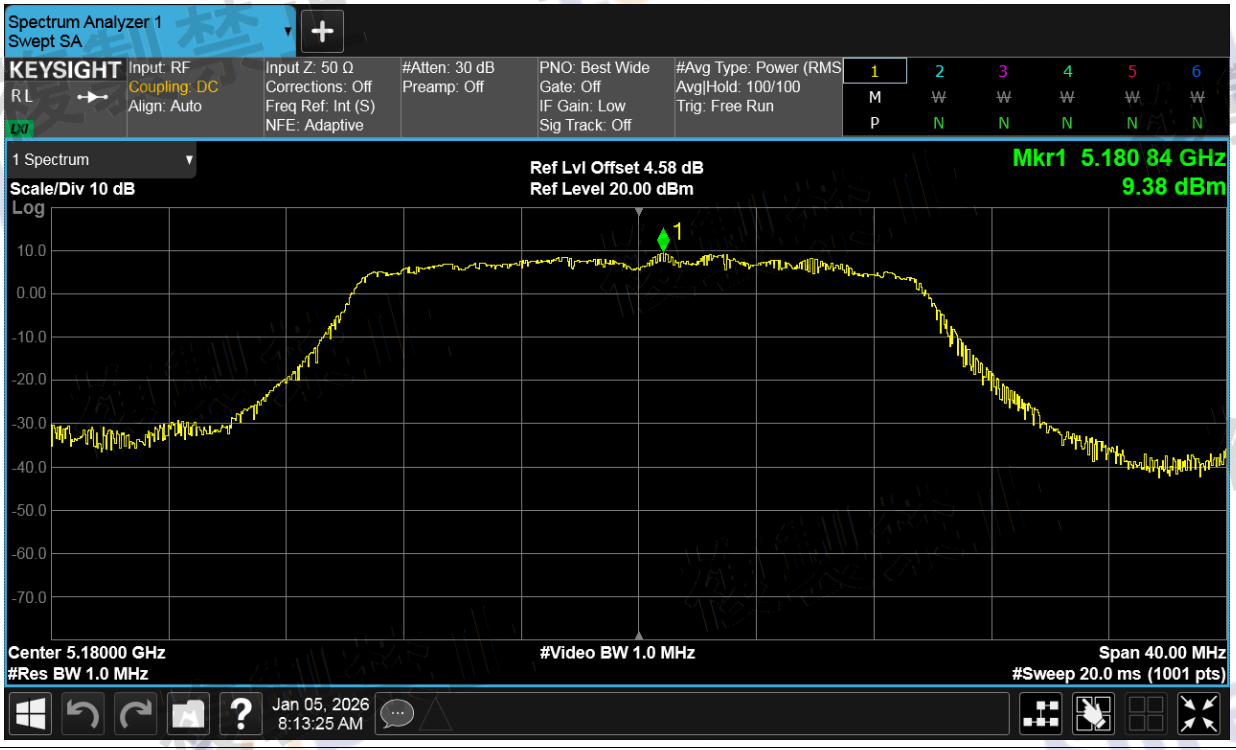


Power NVNT ax20 5180MHz Ant1 Zero Span




Power NVNT ax20 5200MHz Ant1 Pre Scan

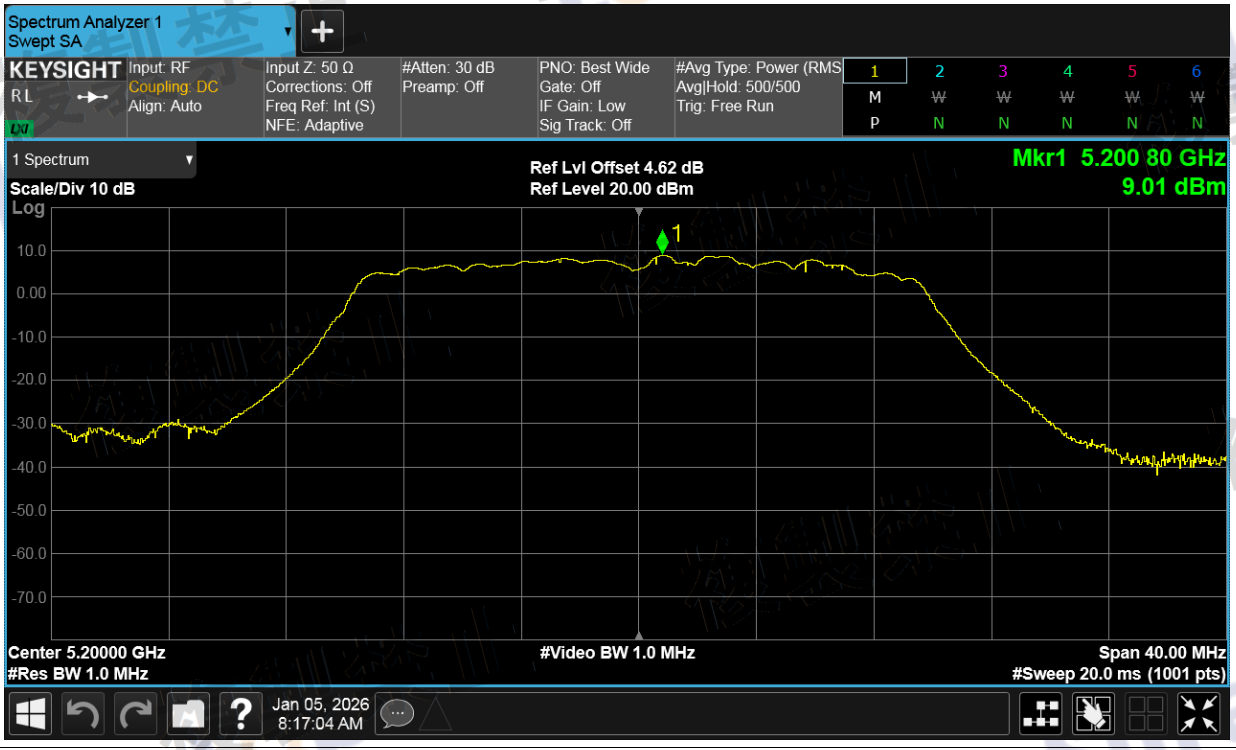


Power NVNT ax20 5200MHz Ant1 Zero Span

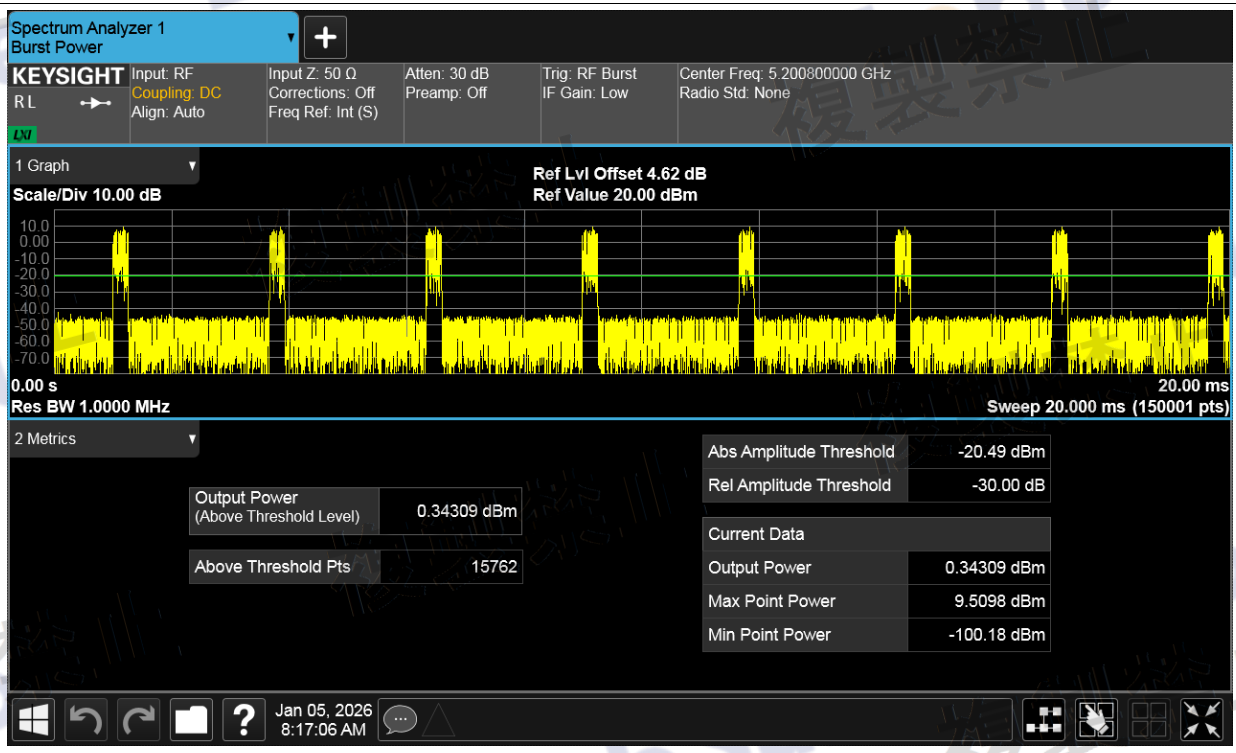


Power NVNT ax20 5240MHz Ant1 Pre Scan

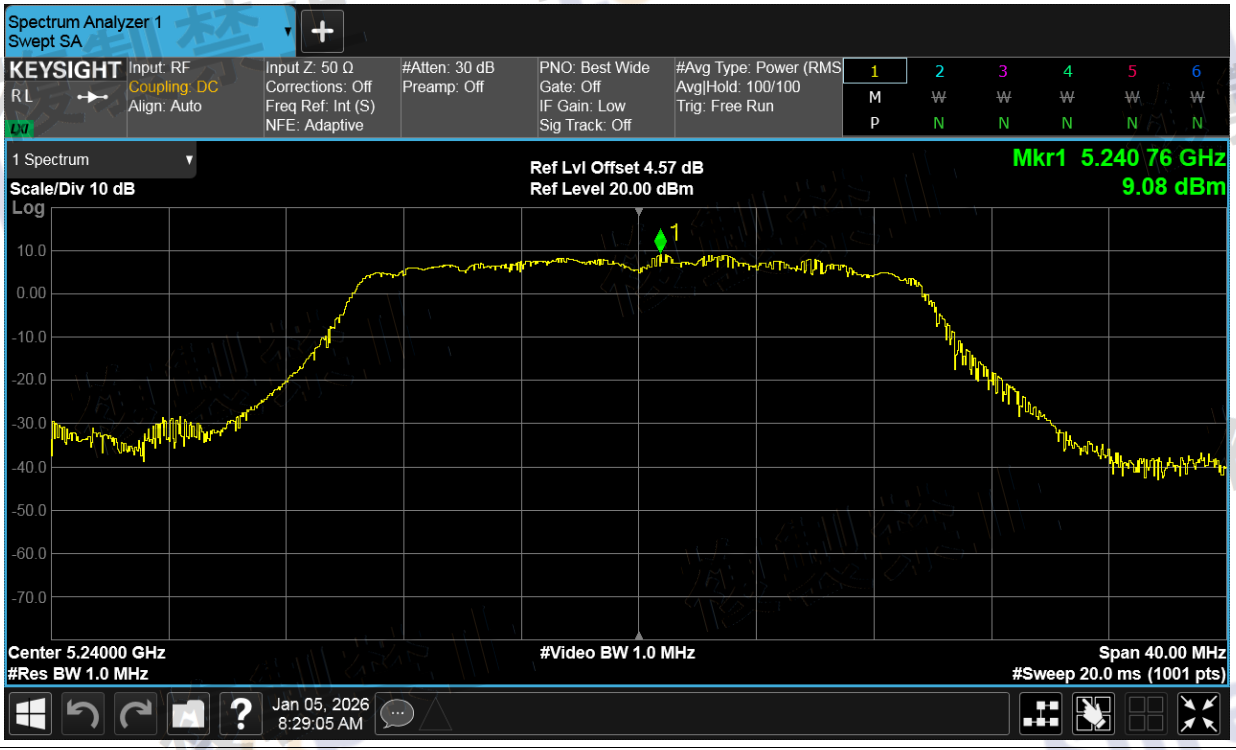


Power NVNT ax20 5240MHz Ant1 Zero Span

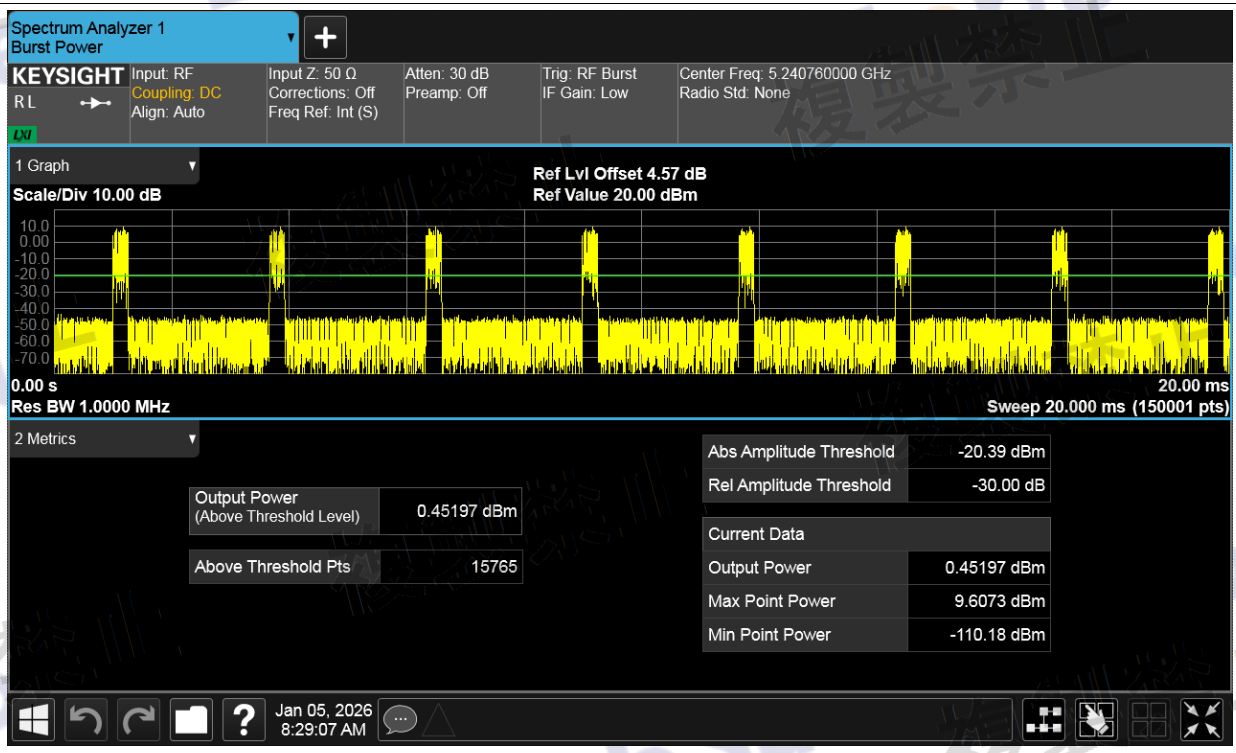


Power NVNT ax20 5260MHz Ant1 Pre Scan

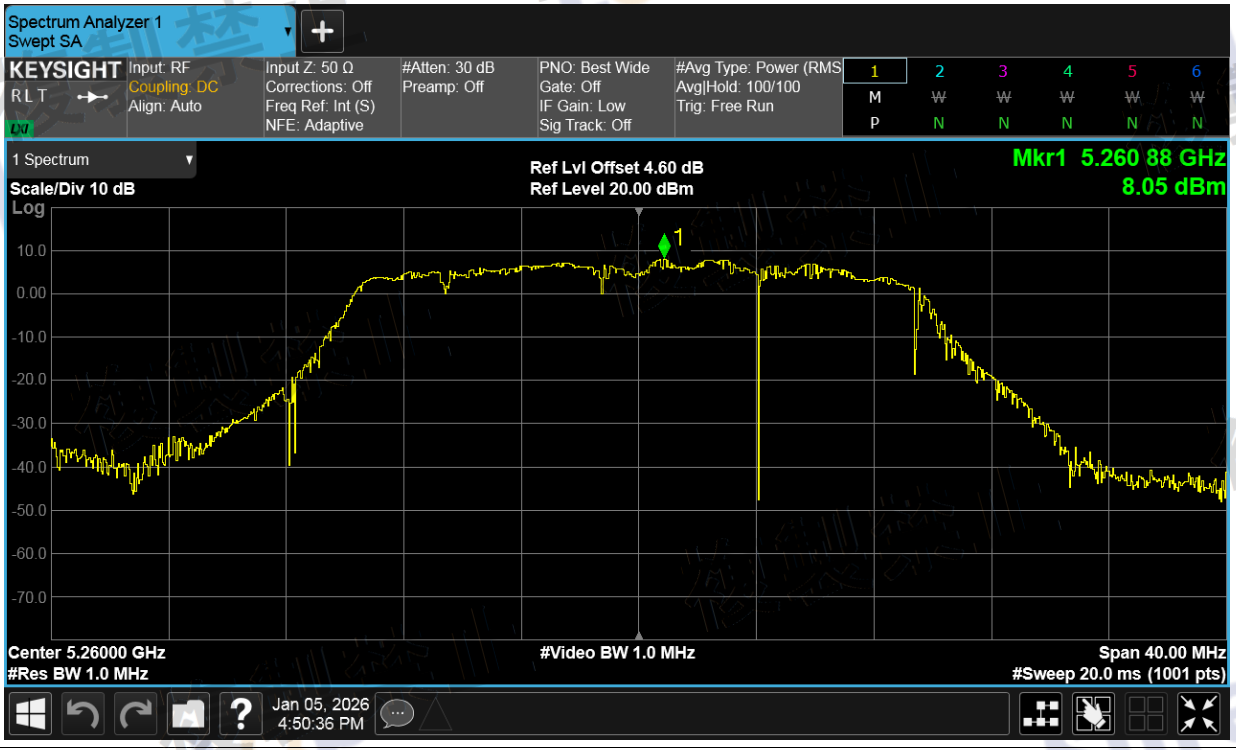


Power NVNT ax20 5260MHz Ant1 Zero Span

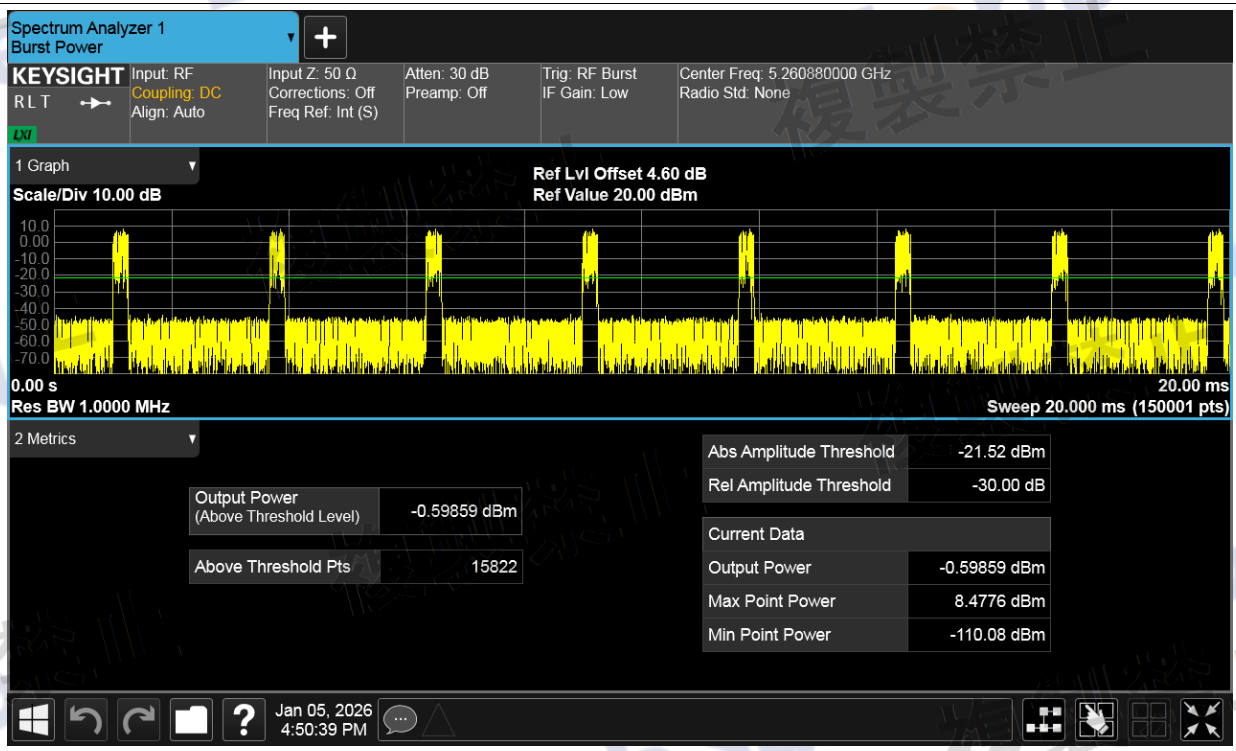


Power NVNT ax20 5300MHz Ant1 Pre Scan

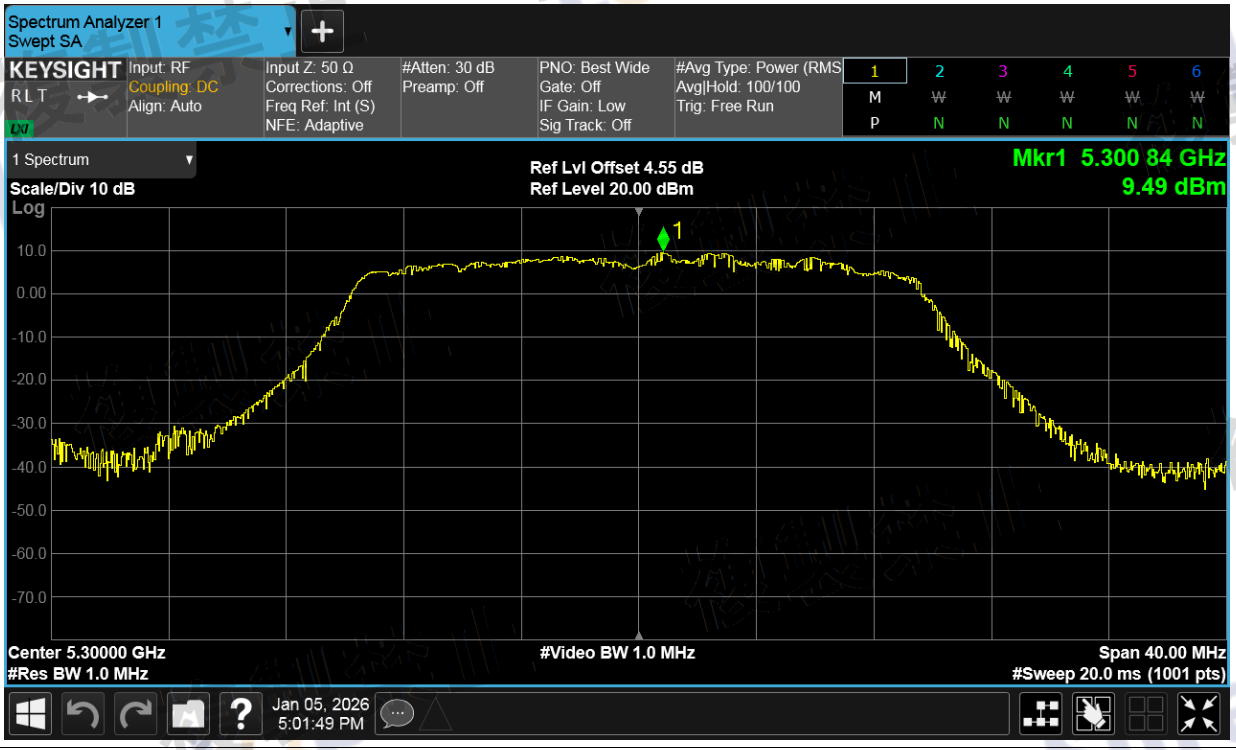


Power NVNT ax20 5300MHz Ant1 Zero Span

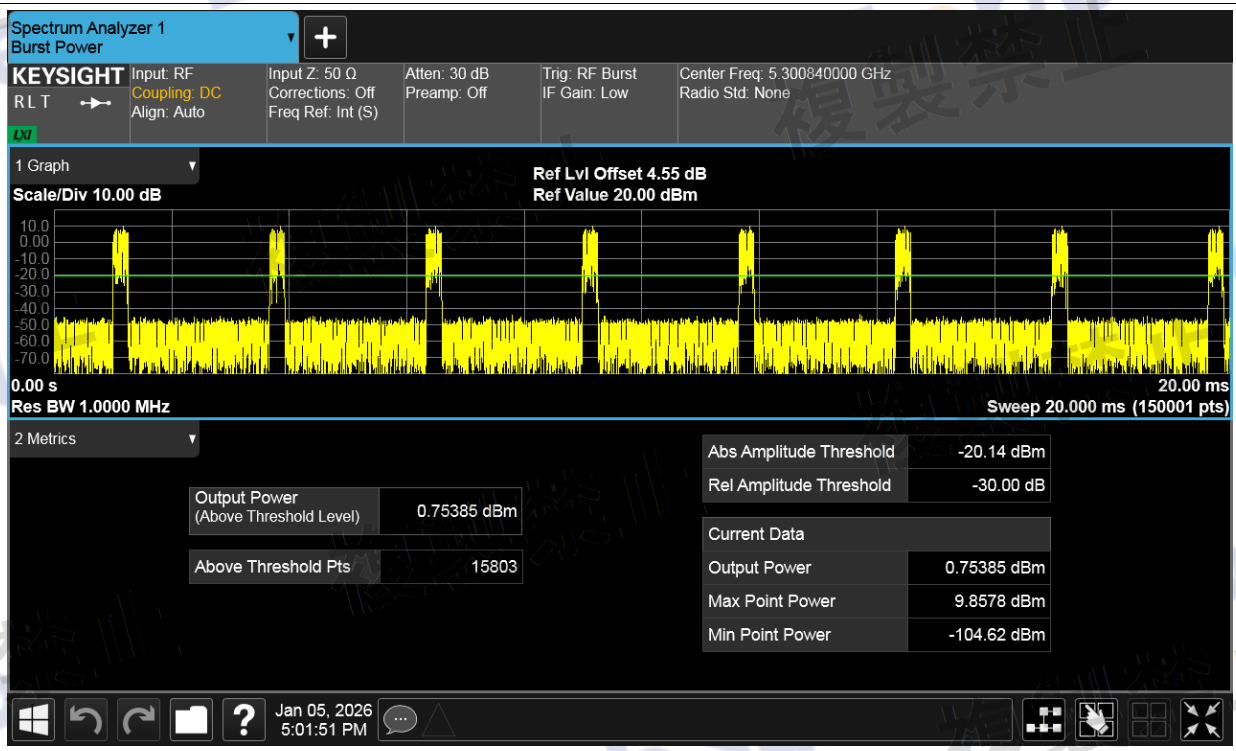


Power NVNT ax20 5320MHz Ant1 Pre Scan

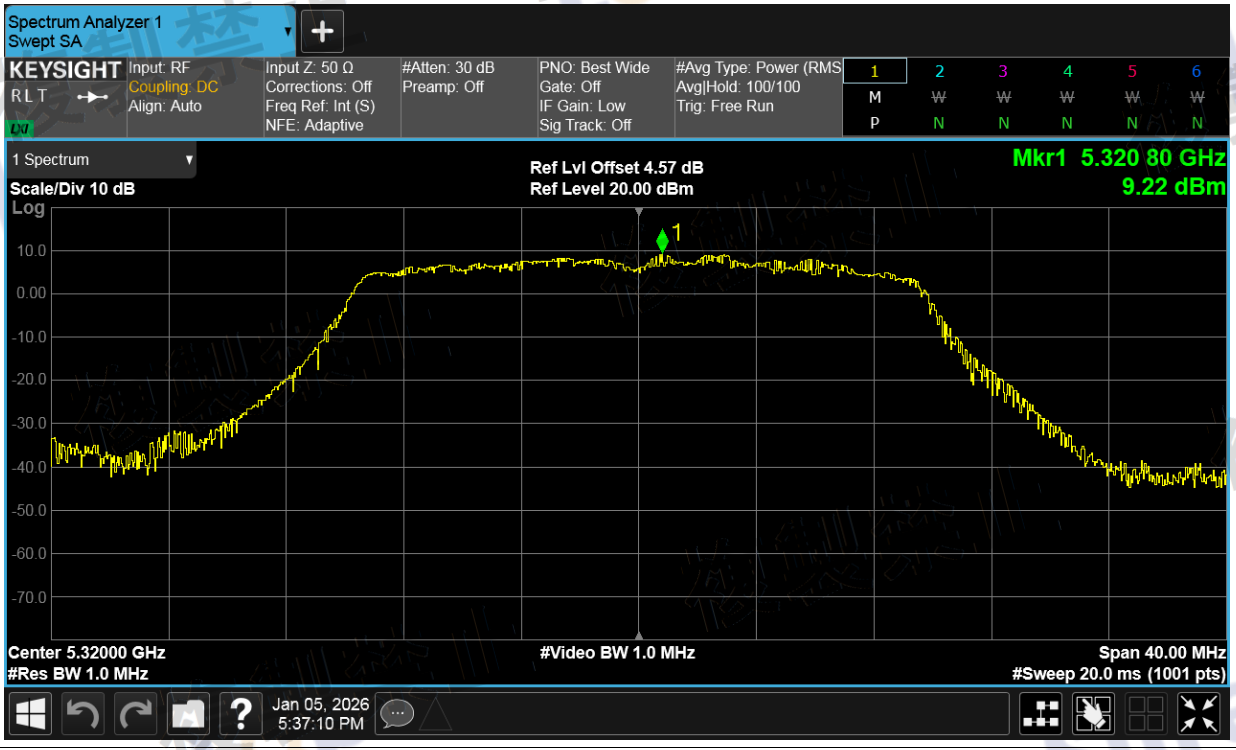


Power NVNT ax20 5320MHz Ant1 Zero Span

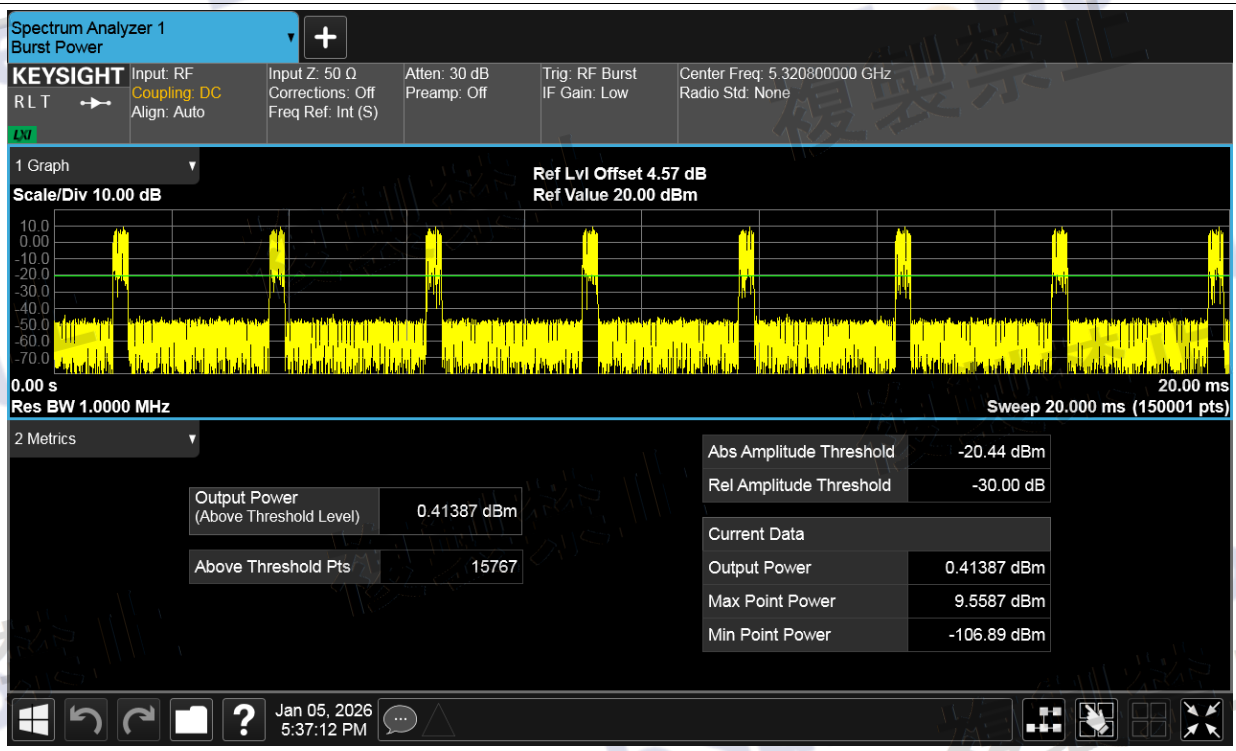


Power NVNT ax20 5500MHz Ant1 Pre Scan

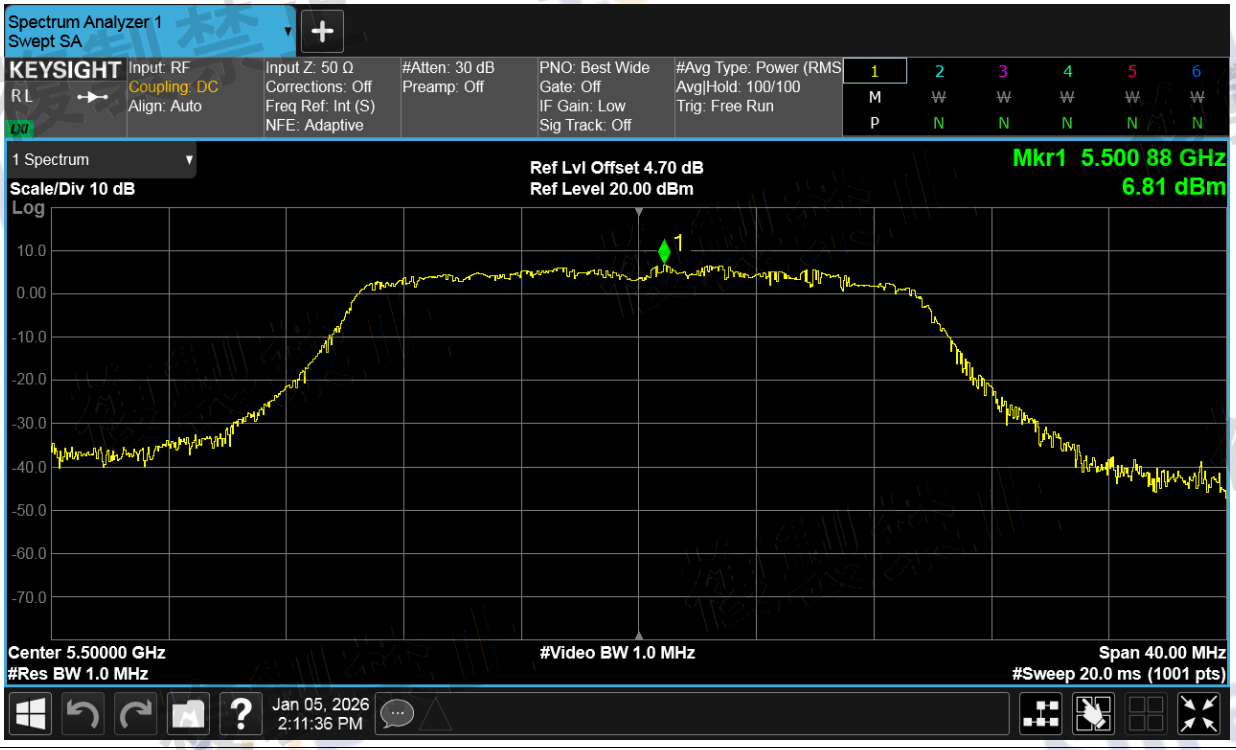


Power NVNT ax20 5500MHz Ant1 Zero Span

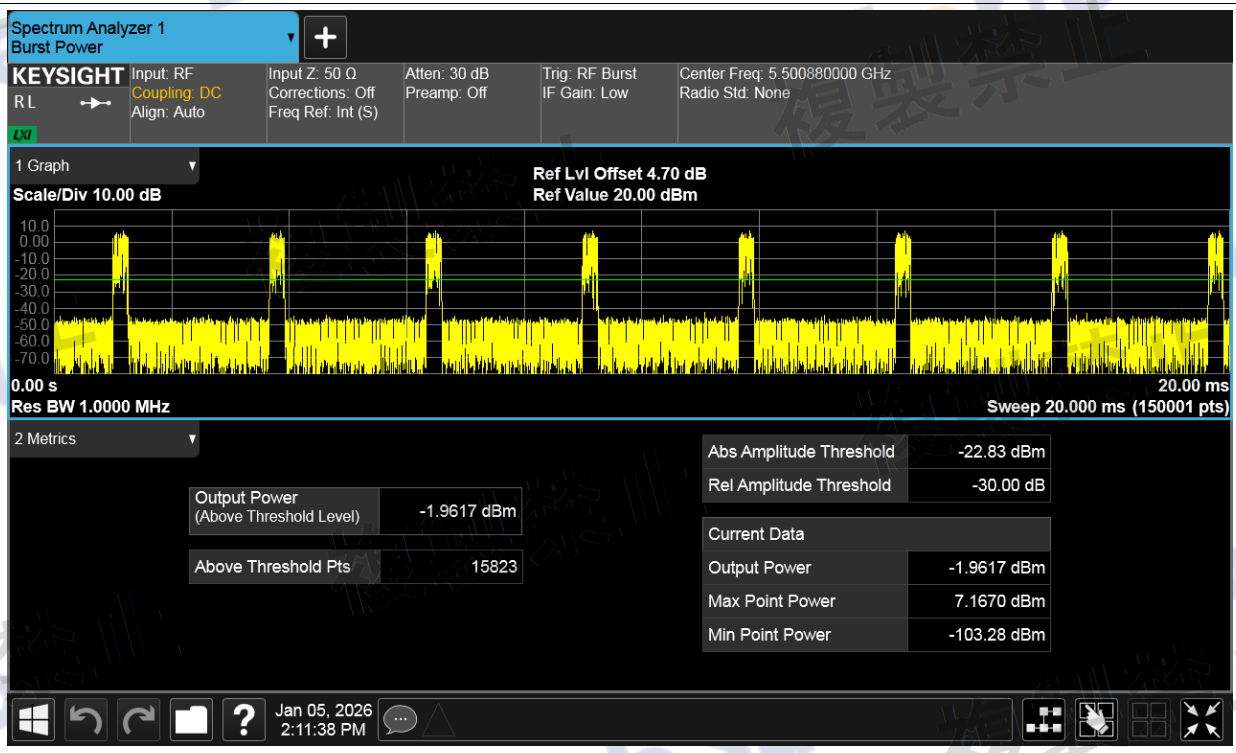


Power NVNT ax20 5580MHz Ant1 Pre Scan

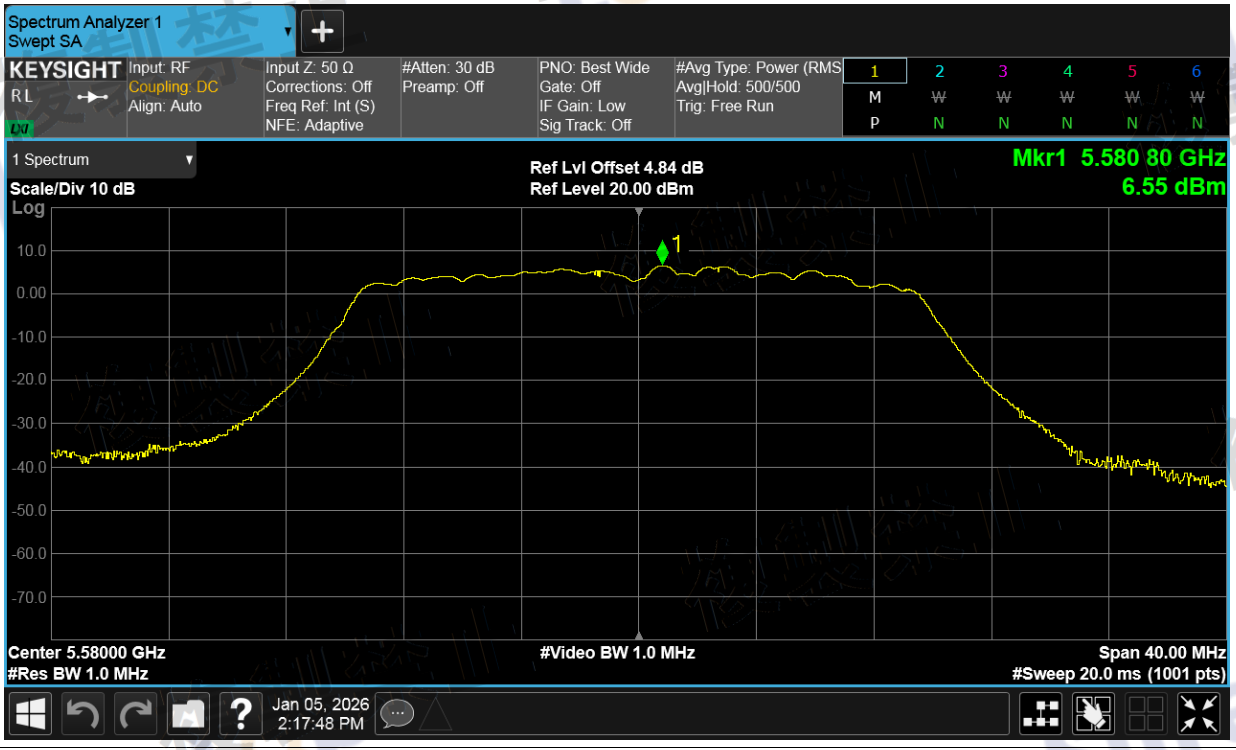


Power NVNT ax20 5580MHz Ant1 Zero Span

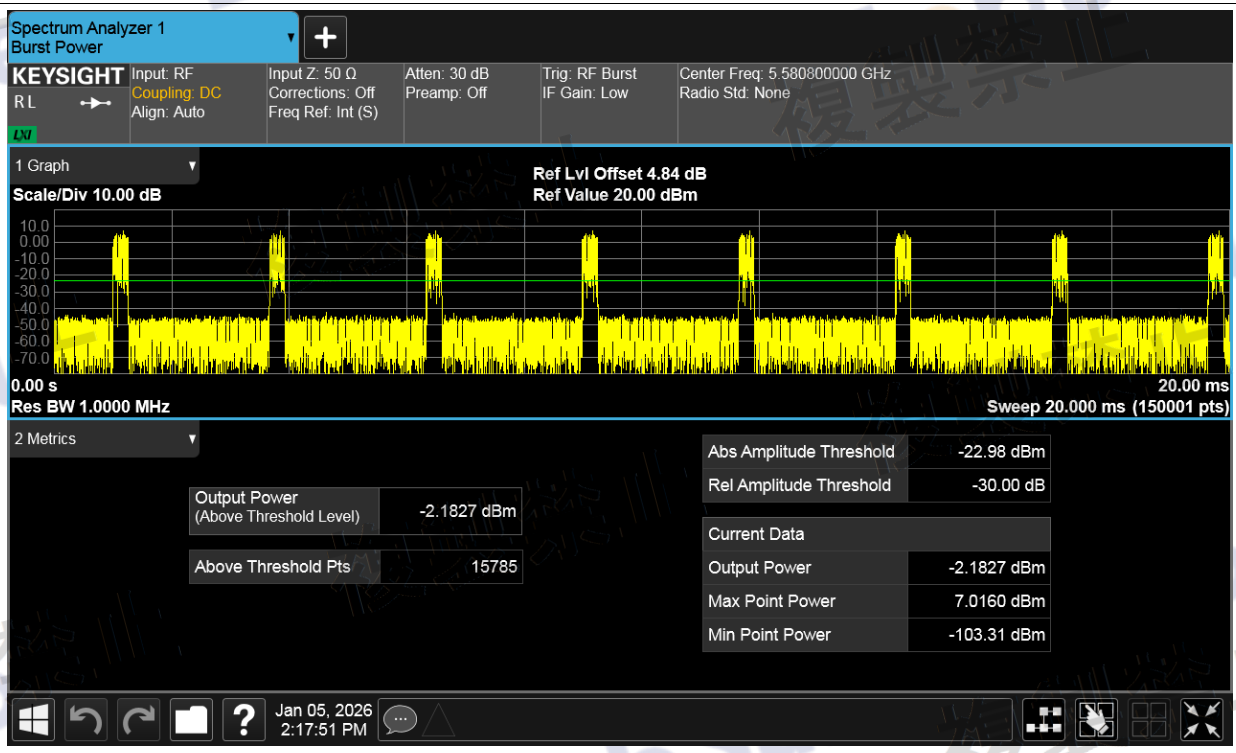


Power NVNT ax20 5700MHz Ant1 Pre Scan

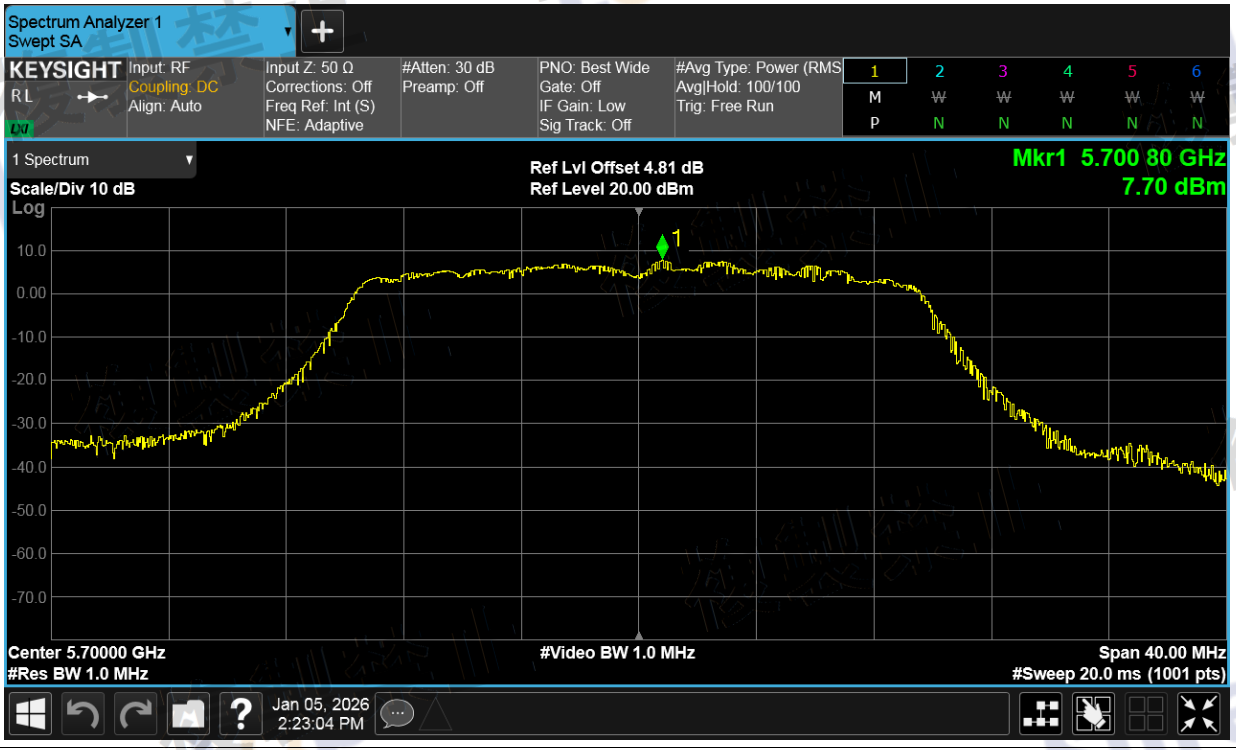


Power NVNT ax20 5700MHz Ant1 Zero Span

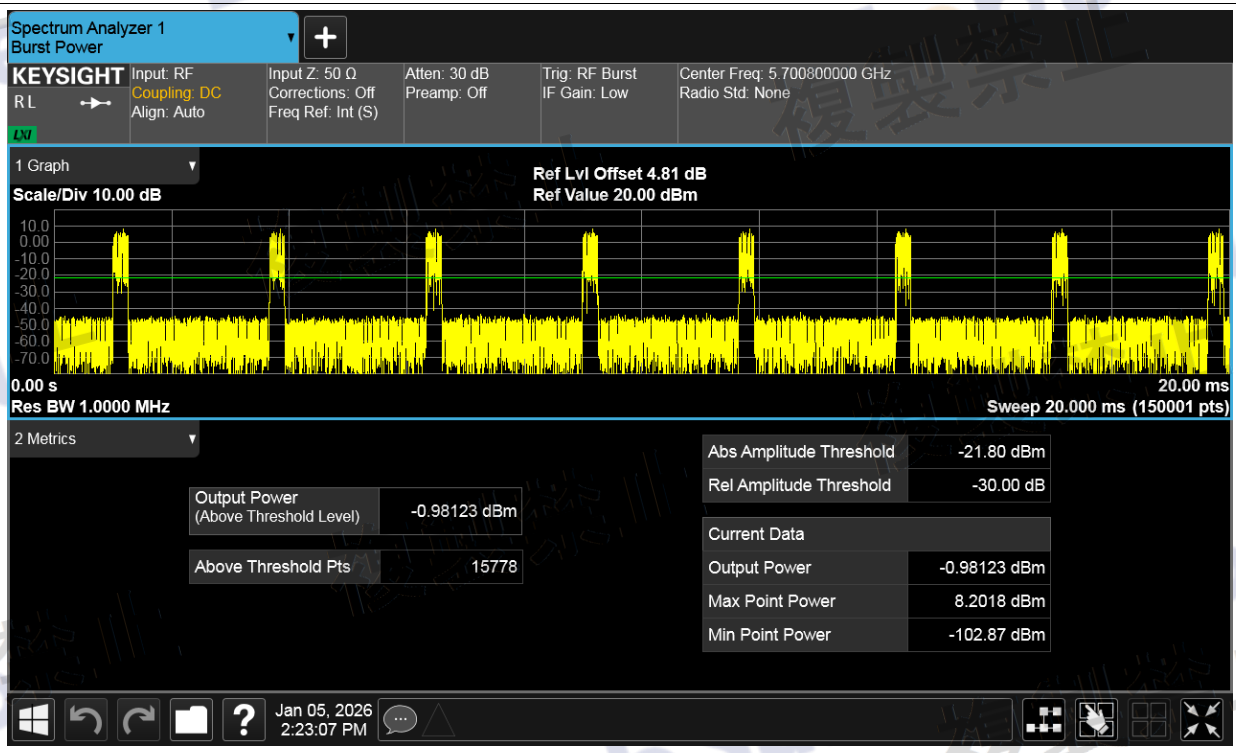


Power NVNT ax40 5190MHz Ant1 Pre Scan

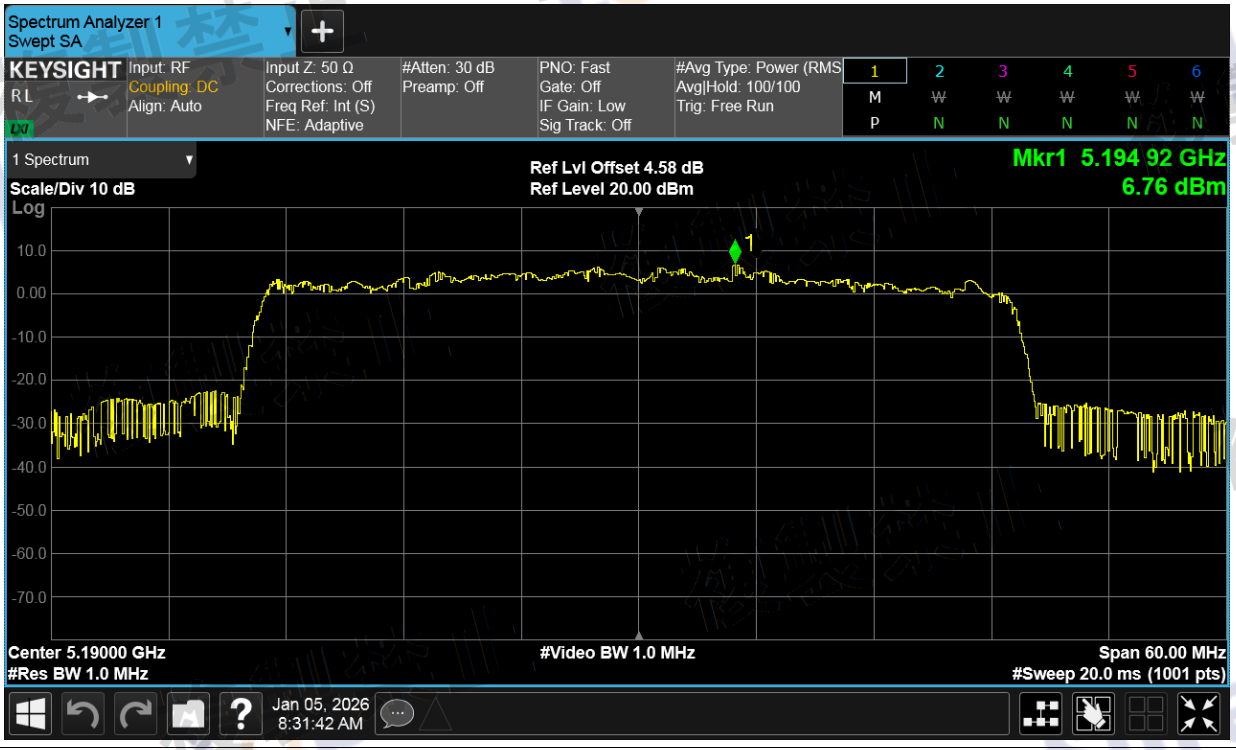


Power NVNT ax40 5190MHz Ant1 Zero Span

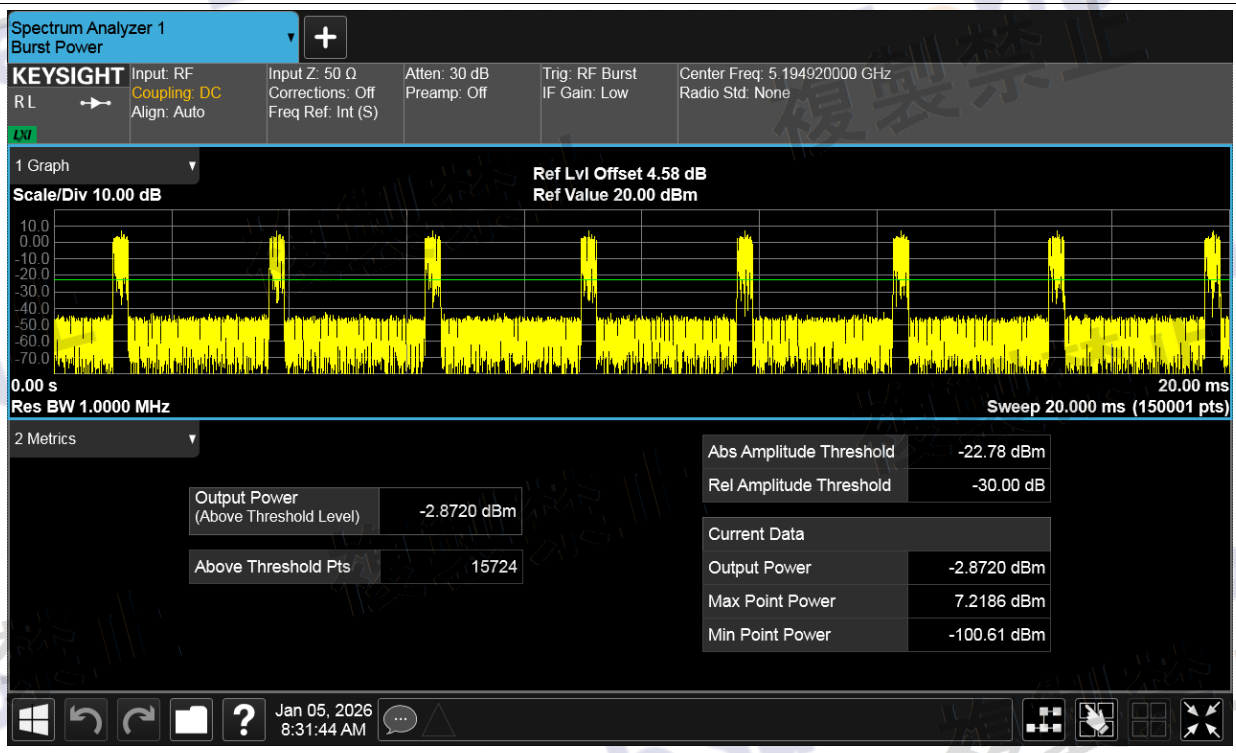


Power NVNT ax40 5200MHz Ant1 Pre Scan

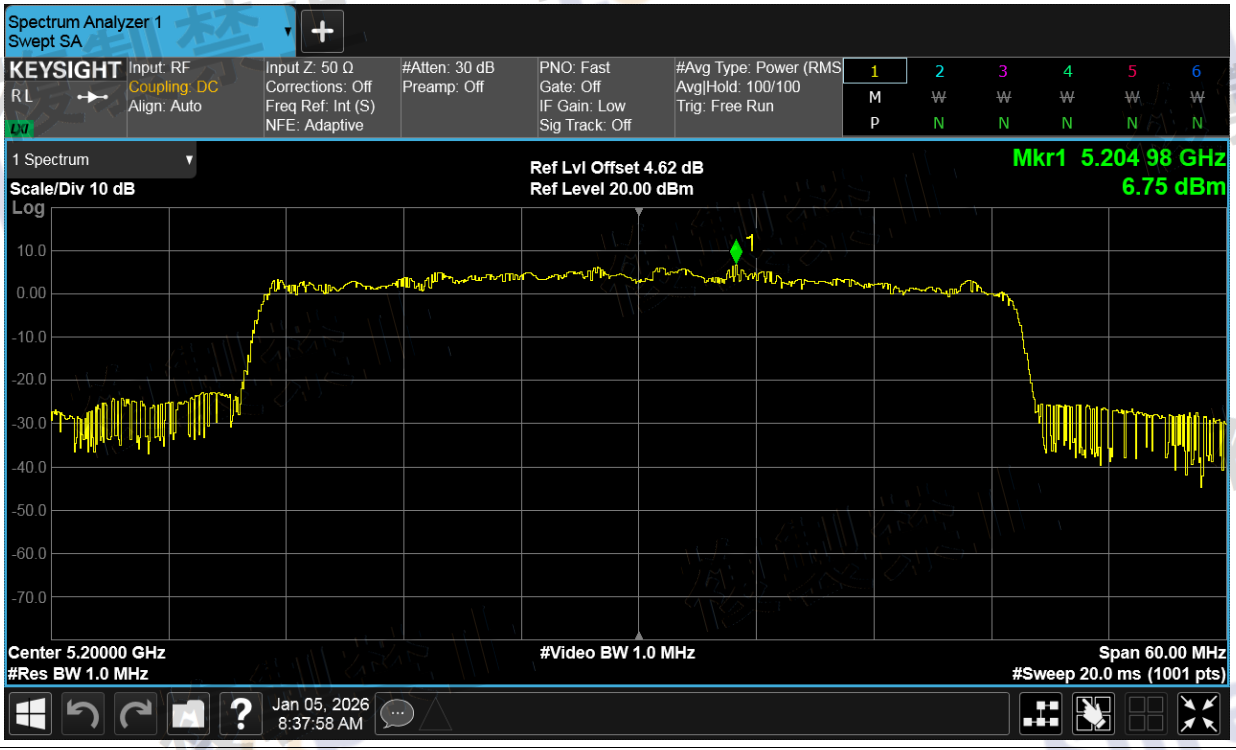


Power NVNT ax40 5200MHz Ant1 Zero Span

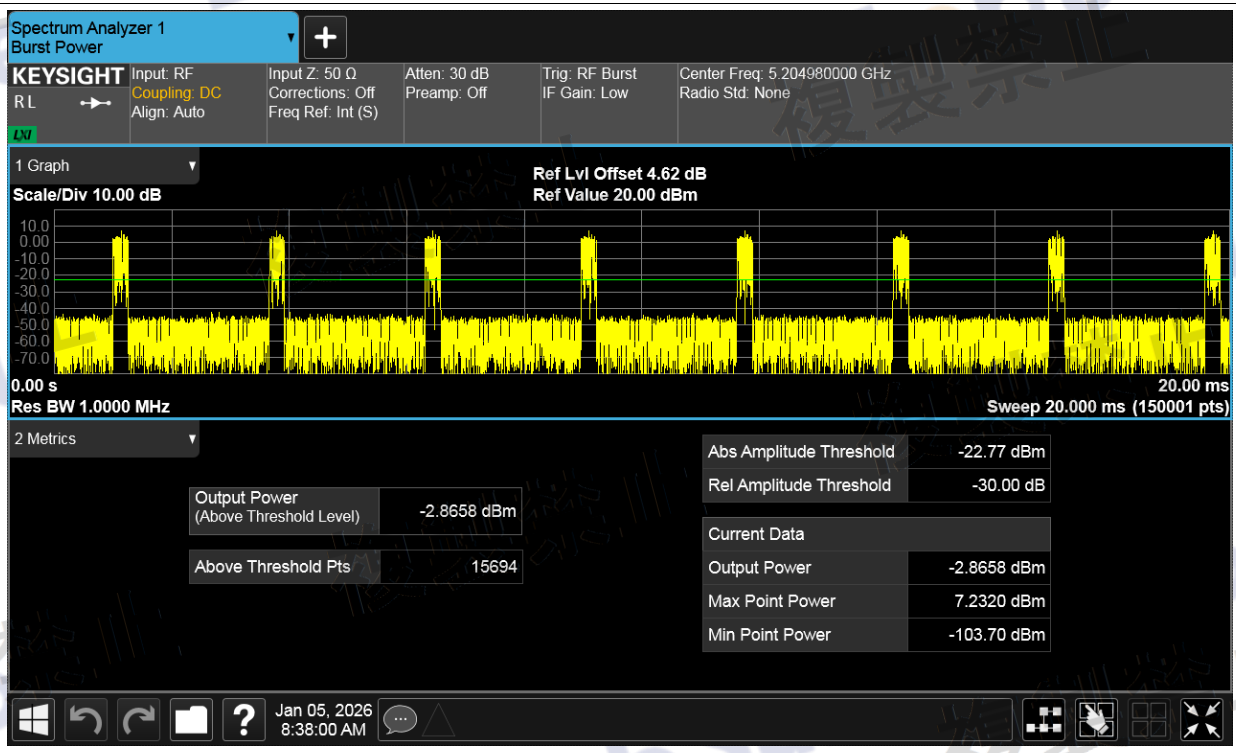


Power NVNT ax40 5230MHz Ant1 Pre Scan

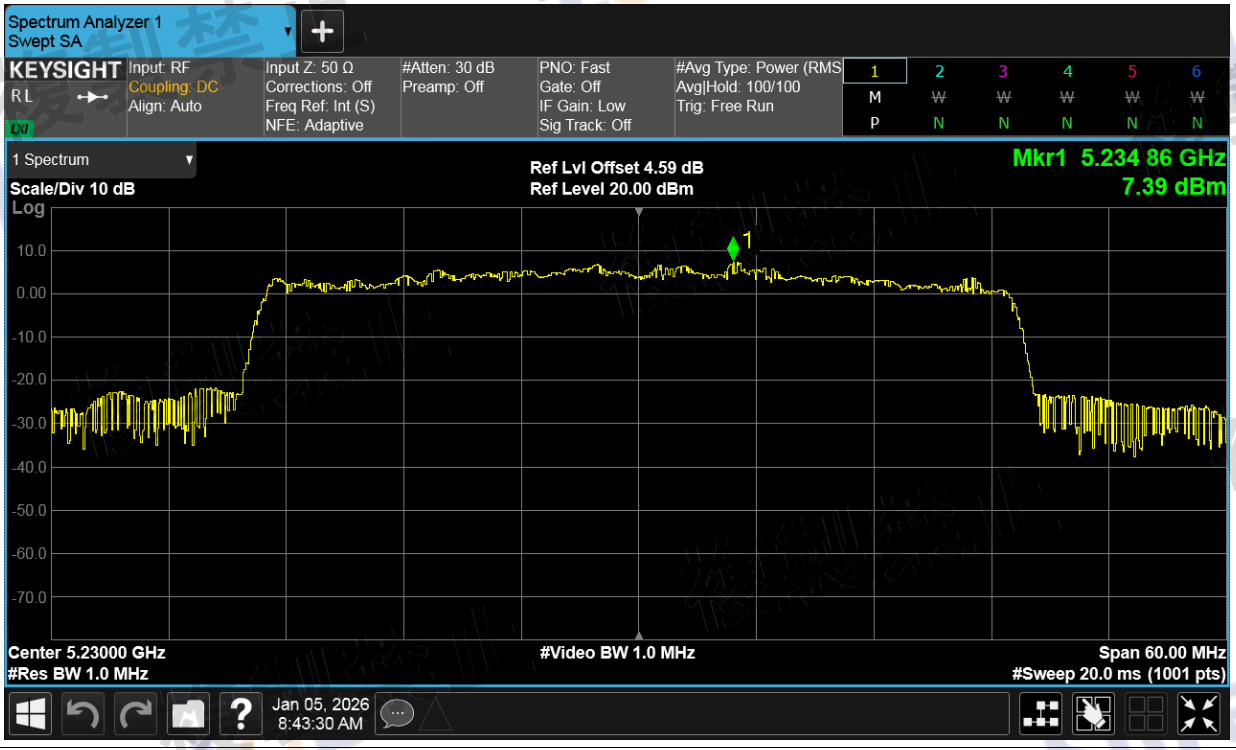


Power NVNT ax40 5230MHz Ant1 Zero Span

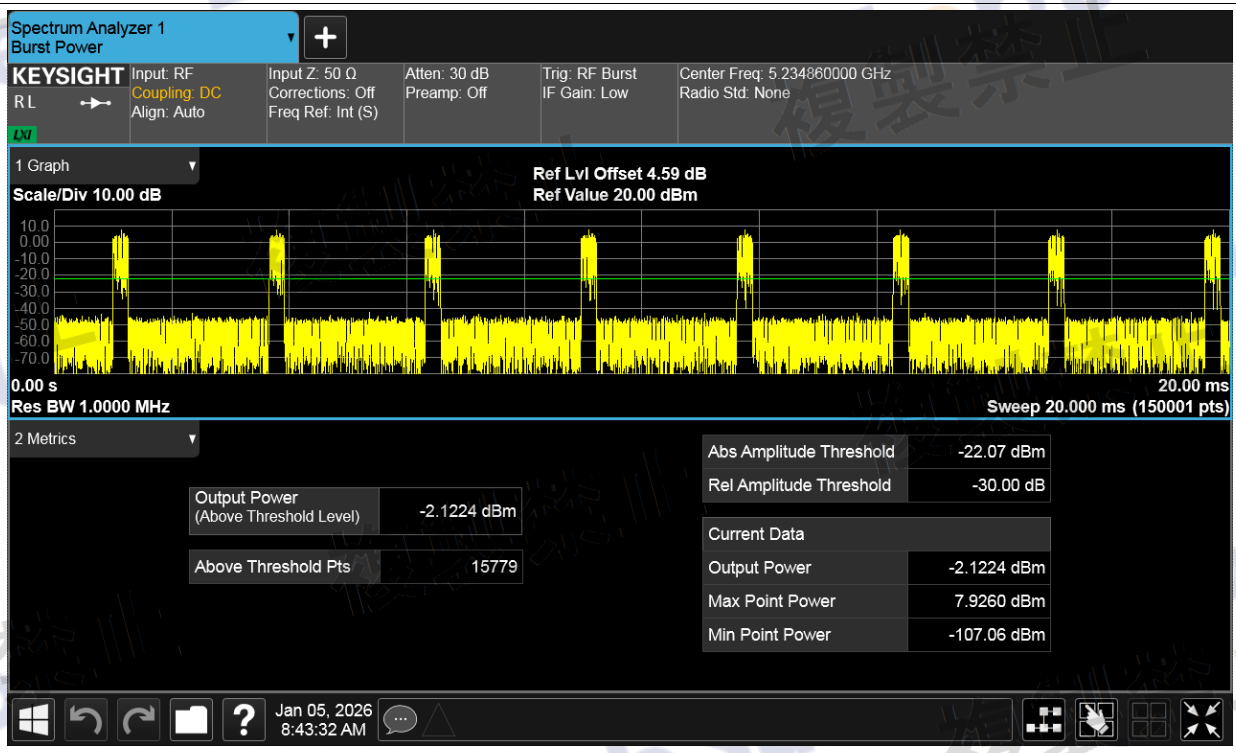


Power NVNT ax40 5270MHz Ant1 Pre Scan

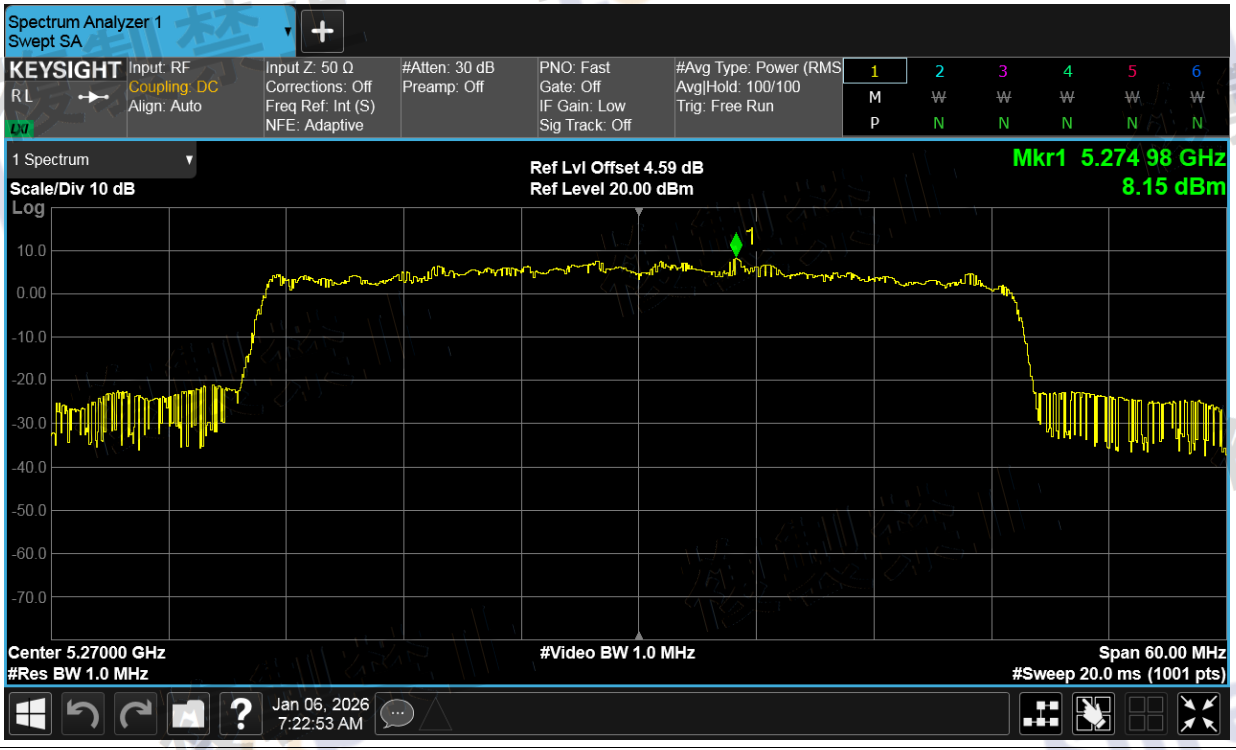


Power NVNT ax40 5270MHz Ant1 Zero Span

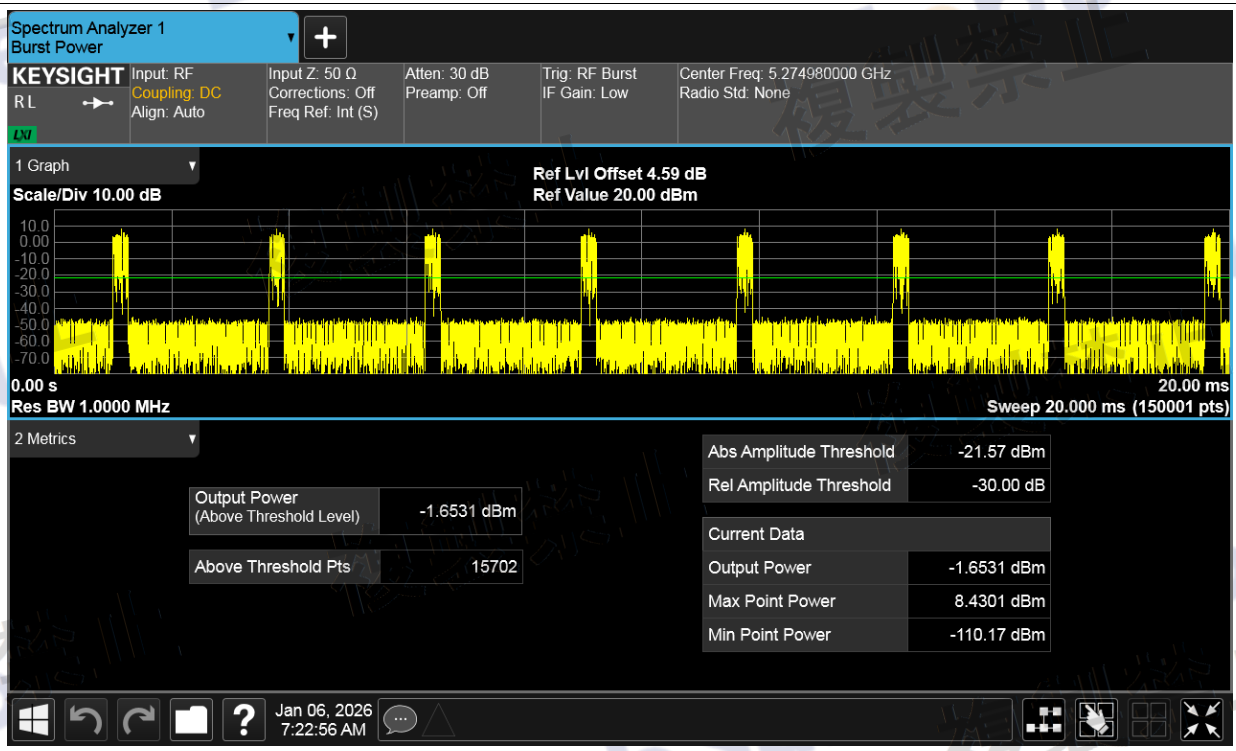


Power NVNT ax40 5310MHz Ant1 Pre Scan

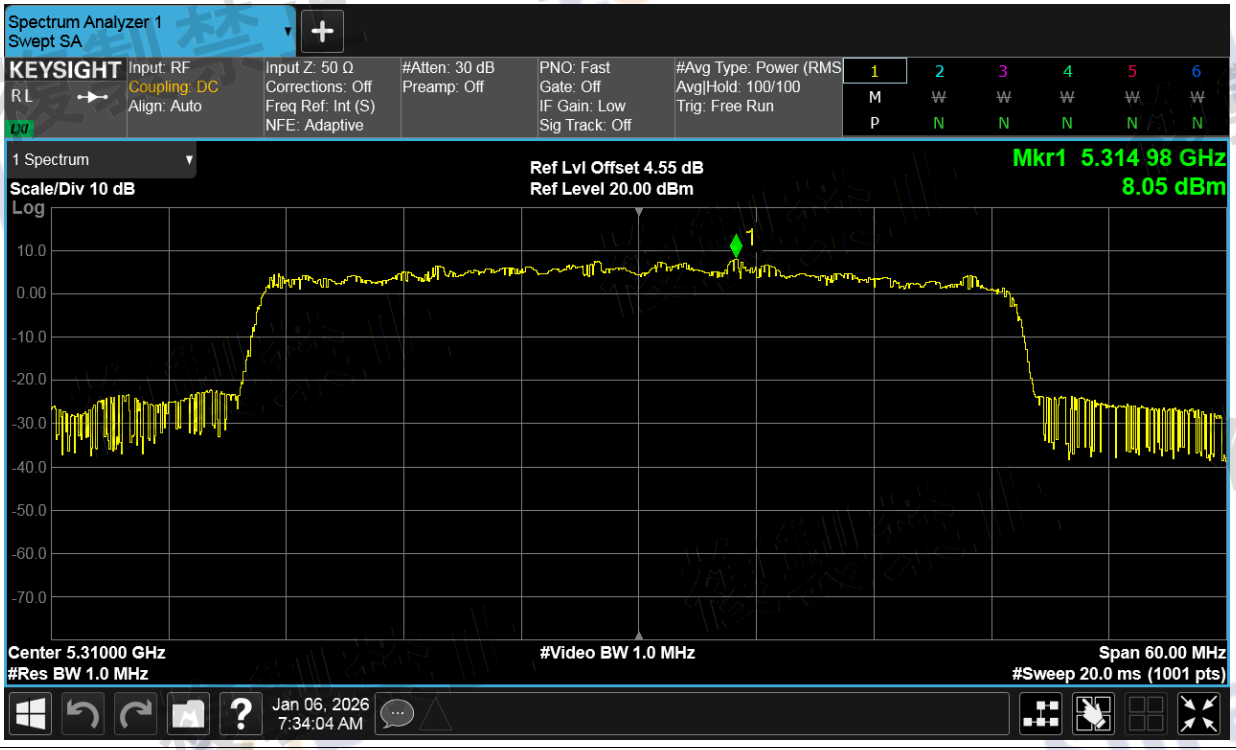


Power NVNT ax40 5310MHz Ant1 Zero Span

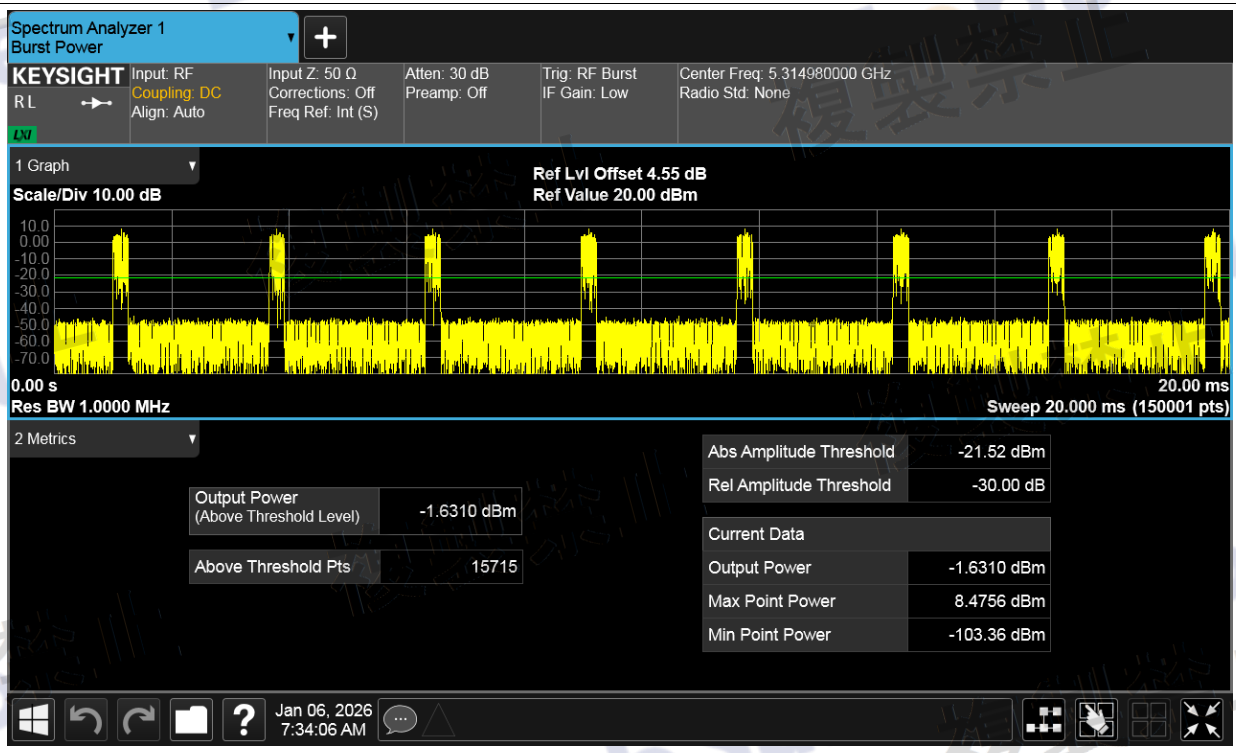


Power NVNT ax40 5510MHz Ant1 Pre Scan

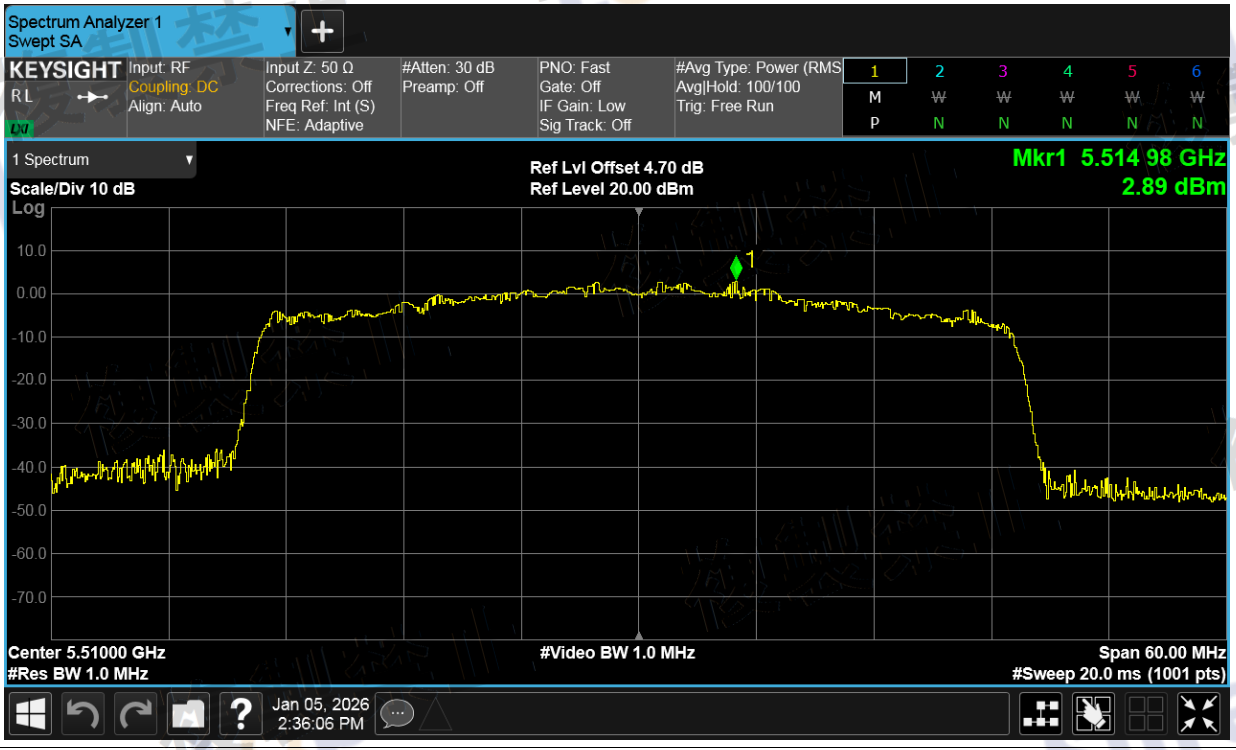


Power NVNT ax40 5510MHz Ant1 Zero Span

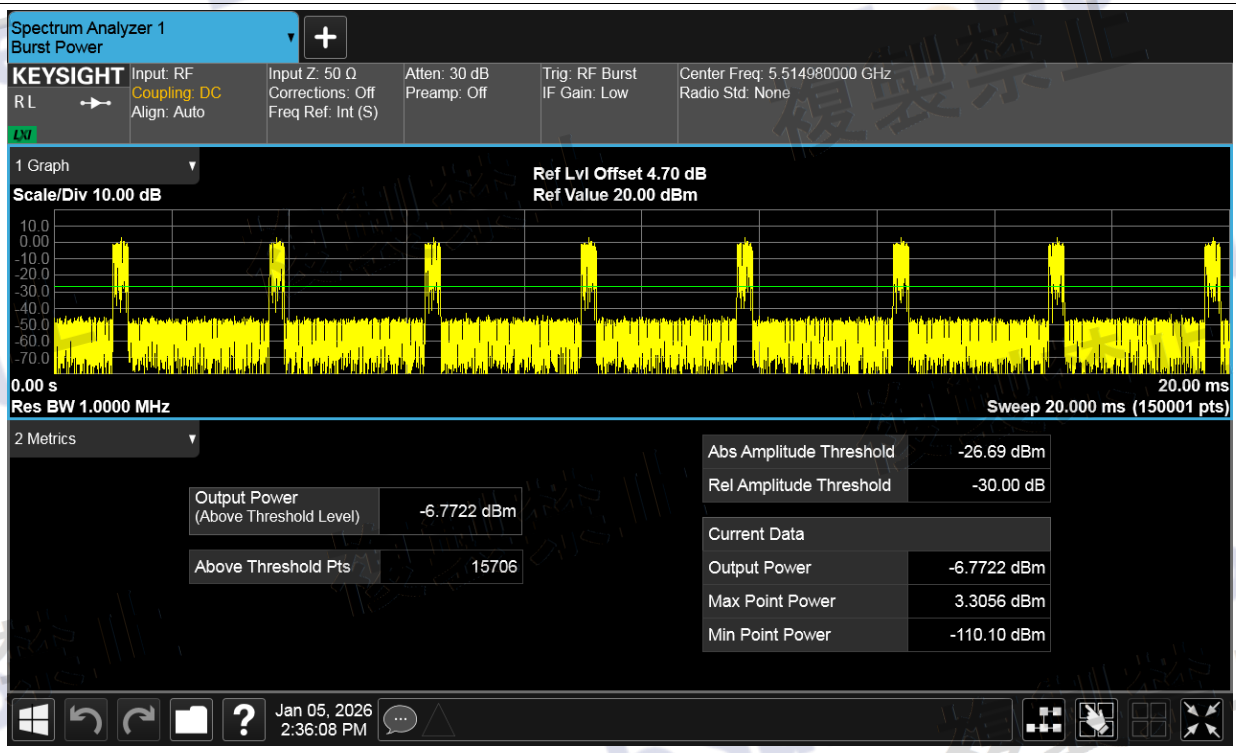


Power NVNT ax40 5590MHz Ant1 Pre Scan

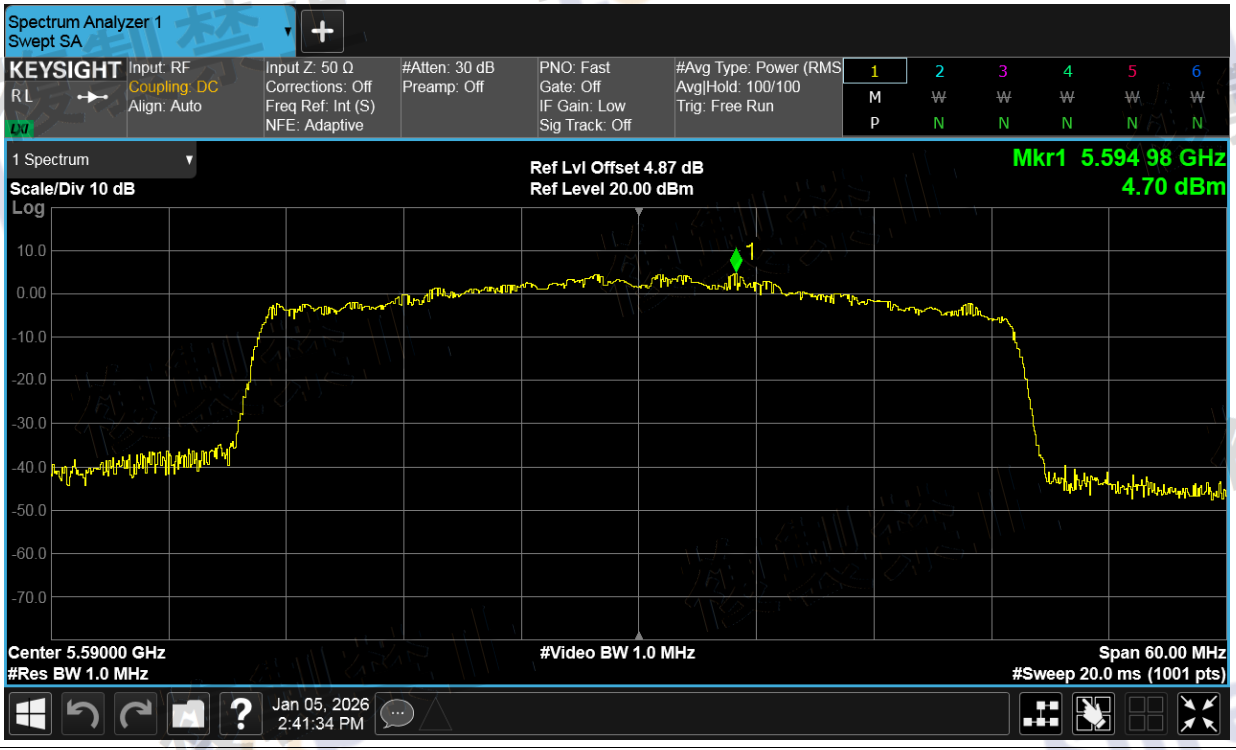


Power NVNT ax40 5590MHz Ant1 Zero Span

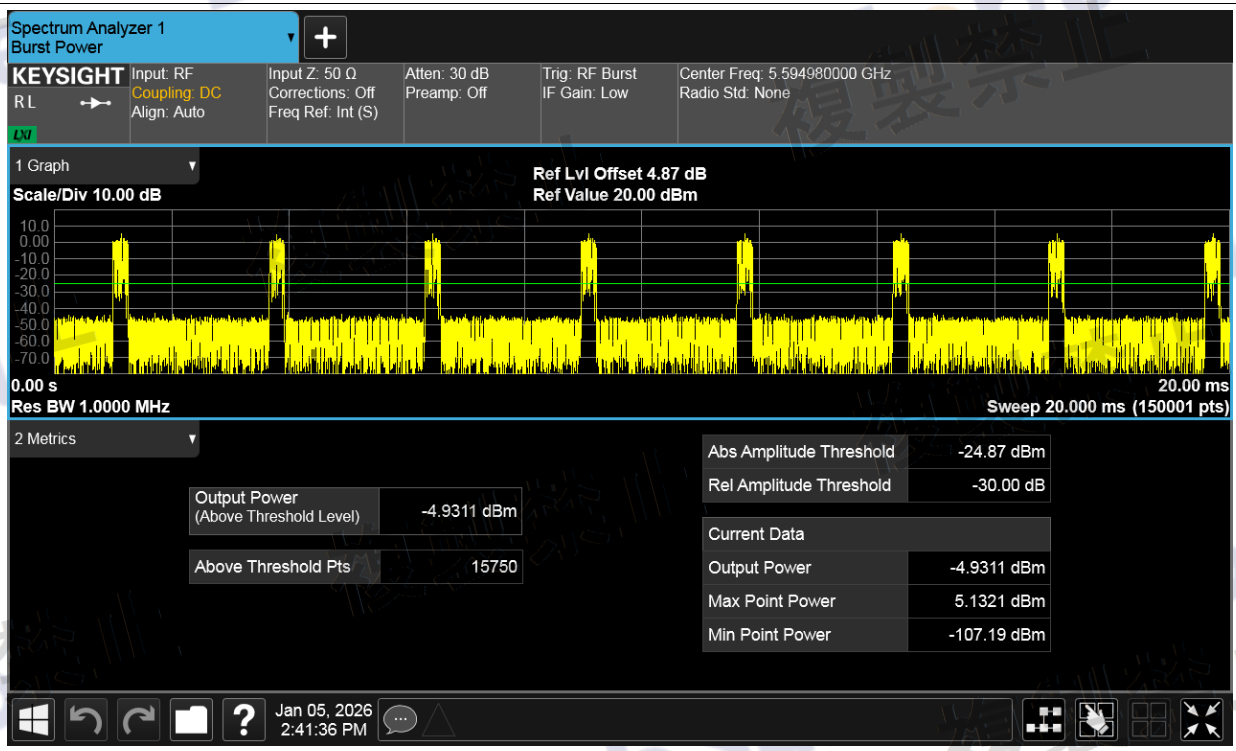

Power NVNT ax40 5670MHz Ant1 Pre Scan

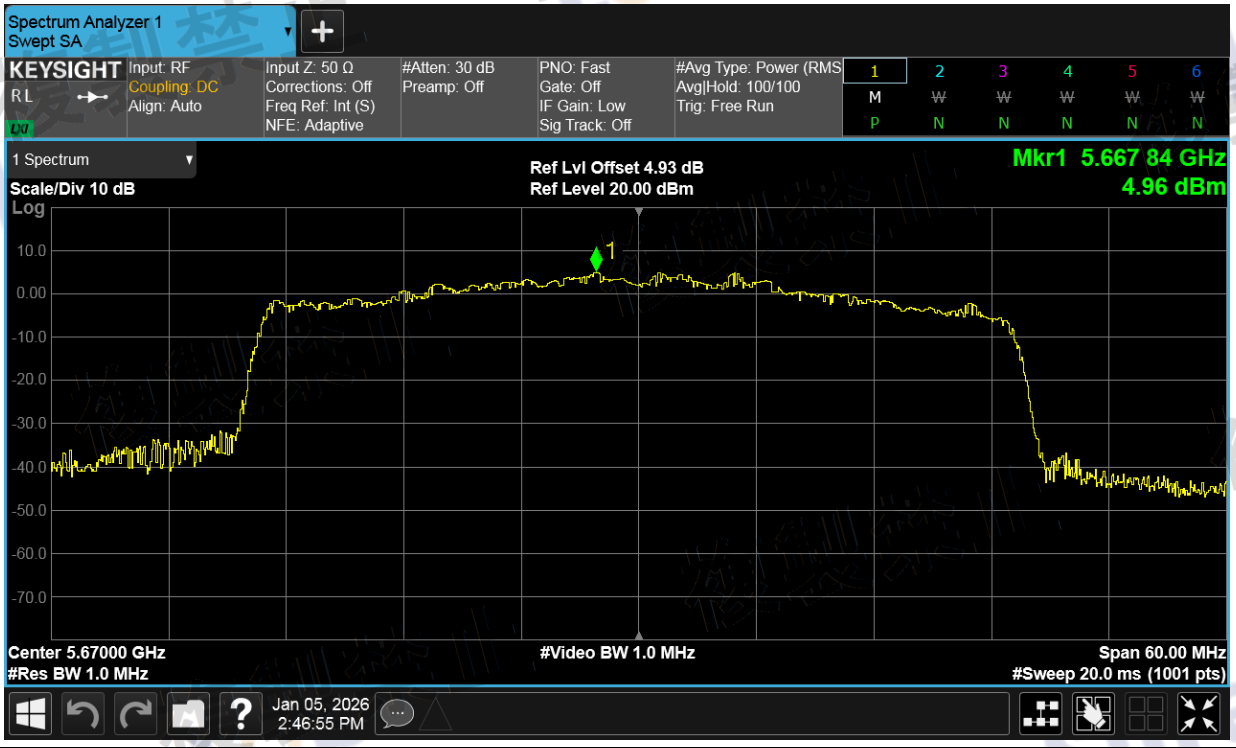

Power NVNT ax40 5670MHz Ant1 Zero Span

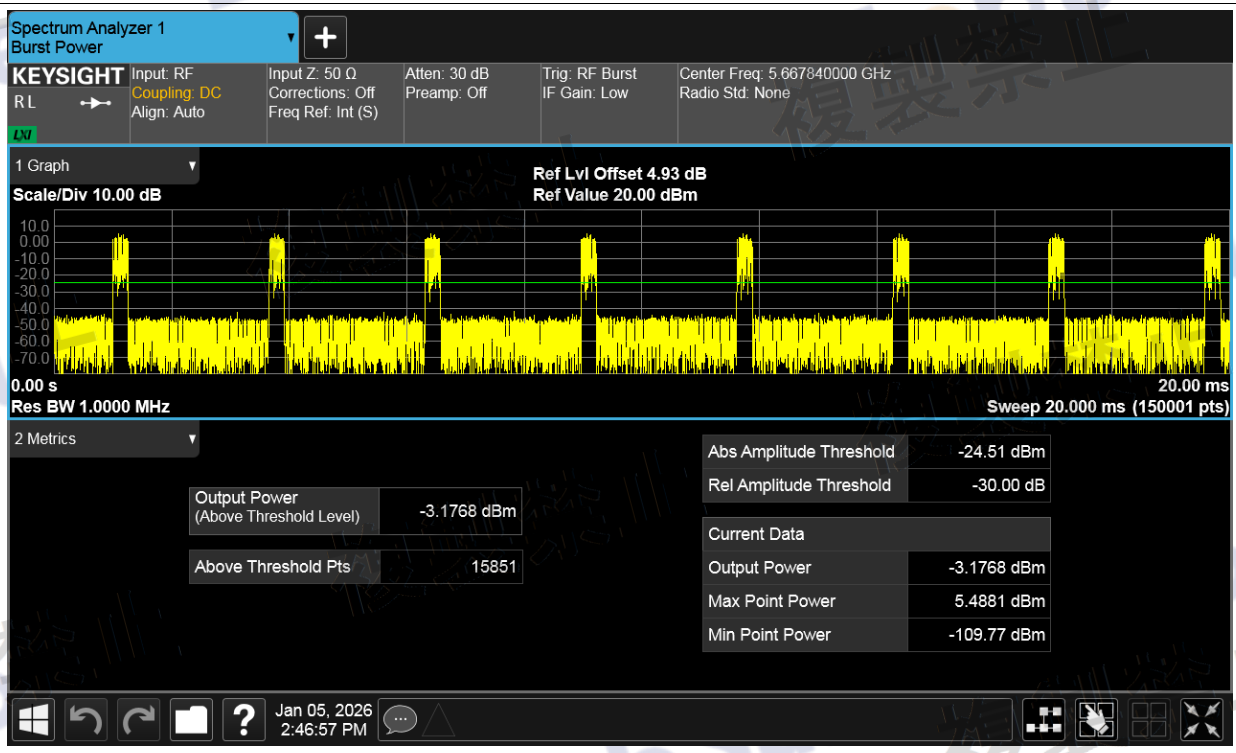

EIRP Power

Condition	Mode	Frequency (MHz)	Antenna	Antenna Power (mW/MHz)	Gain (dBi)	EIRP Power (dBm/MHz)	EIRP Power (mW/MHz)	Limit (mW/MHz)	Verdict
NVNT	a	5180	Ant1	1.5	2.66	4.41	2.76	10	Pass
NVNT	a	5200	Ant1	1.38	2.66	4.07	2.55	10	Pass
NVNT	a	5240	Ant1	1.56	2.66	4.6	2.88	10	Pass
NVNT	a	5260	Ant1	0.97	2.66	2.53	1.79	5	Pass
NVNT	a	5300	Ant1	1.37	2.66	4.04	2.54	5	Pass
NVNT	a	5320	Ant1	1.32	2.66	3.88	2.44	5	Pass
NVNT	a	5500	Ant1	0.79	4.09	3.06	2.02	25	Pass
NVNT	a	5580	Ant1	0.74	4.09	2.8	1.91	25	Pass
NVNT	a	5700	Ant1	0.97	4.09	3.96	2.49	25	Pass
NVNT	n20	5180	Ant1	1.4	2.66	4.11	2.58	10	Pass
NVNT	n20	5200	Ant1	1.28	2.66	3.72	2.36	10	Pass
NVNT	n20	5240	Ant1	1.44	2.66	4.23	2.65	10	Pass
NVNT	n20	5260	Ant1	0.97	2.66	2.52	1.79	5	Pass
NVNT	n20	5300	Ant1	1.36	2.66	4.01	2.52	5	Pass
NVNT	n20	5320	Ant1	1.29	2.66	3.75	2.37	5	Pass
NVNT	n20	5500	Ant1	0.74	4.09	2.78	1.90	25	Pass
NVNT	n20	5580	Ant1	0.69	4.09	2.51	1.78	25	Pass
NVNT	n20	5700	Ant1	0.93	4.09	3.76	2.38	25	Pass
NVNT	n40	5190	Ant1	0.77	2.66	1.52	1.42	5	Pass
NVNT	n40	5200	Ant1	0.74	2.66	1.32	1.36	5	Pass
NVNT	n40	5230	Ant1	0.83	2.66	1.84	1.53	5	Pass
NVNT	n40	5270	Ant1	0.55	2.66	0.1	1.02	2.5	Pass
NVNT	n40	5310	Ant1	0.55	2.66	0.07	1.02	2.5	Pass
NVNT	n40	5510	Ant1	0.3	4.09	-1.14	0.77	12.5	Pass
NVNT	n40	5590	Ant1	0.47	4.09	0.78	1.20	12.5	Pass
NVNT	n40	5670	Ant1	0.53	4.09	1.32	1.36	12.5	Pass
NVNT	ac20	5180	Ant1	1.28	2.66	3.74	2.37	10	Pass
NVNT	ac20	5200	Ant1	1.21	2.66	3.48	2.23	10	Pass
NVNT	ac20	5240	Ant1	1.35	2.66	3.96	2.49	10	Pass
NVNT	ac20	5260	Ant1	1.43	2.66	4.2	2.63	5	Pass
NVNT	ac20	5300	Ant1	1.75	2.66	5.08	3.22	5	Pass
NVNT	ac20	5320	Ant1	1.59	2.66	4.67	2.93	5	Pass
NVNT	ac20	5500	Ant1	0.7	4.09	2.56	1.80	25	Pass
NVNT	ac20	5580	Ant1	0.68	4.09	2.38	1.73	25	Pass
NVNT	ac20	5700	Ant1	0.89	4.09	3.57	2.28	25	Pass
NVNT	ac40	5190	Ant1	0.65	2.66	0.8	1.20	5	Pass
NVNT	ac40	5200	Ant1	0.61	2.66	0.51	1.12	5	Pass
NVNT	ac40	5230	Ant1	0.69	2.66	1.04	1.27	5	Pass
NVNT	ac40	5270	Ant1	0.84	2.66	1.9	1.55	2.5	Pass
NVNT	ac40	5310	Ant1	0.8	2.66	1.68	1.47	2.5	Pass


NVNT	ac40	5510	Ant1	0.25	4.09	-2.01	0.63	12.5	Pass
NVNT	ac40	5590	Ant1	0.39	4.09	-0.03	0.99	12.5	Pass
NVNT	ac40	5670	Ant1	0.41	4.09	0.26	1.06	12.5	Pass
NVNT	ax20	5180	Ant1	1.19	2.66	3.42	2.20	10	Pass
NVNT	ax20	5200	Ant1	1.08	2.66	3	2.00	10	Pass
NVNT	ax20	5240	Ant1	1.11	2.66	3.11	2.05	10	Pass
NVNT	ax20	5260	Ant1	0.87	2.66	2.06	1.61	5	Pass
NVNT	ax20	5300	Ant1	1.19	2.66	3.41	2.19	5	Pass
NVNT	ax20	5320	Ant1	1.1	2.66	3.07	2.03	5	Pass
NVNT	ax20	5500	Ant1	0.64	4.09	2.13	1.63	25	Pass
NVNT	ax20	5580	Ant1	0.6	4.09	1.91	1.55	25	Pass
NVNT	ax20	5700	Ant1	0.8	4.09	3.11	2.05	25	Pass
NVNT	ax40	5190	Ant1	0.52	2.66	-0.21	0.95	5	Pass
NVNT	ax40	5200	Ant1	0.52	2.66	-0.21	0.95	5	Pass
NVNT	ax40	5230	Ant1	0.61	2.66	0.54	1.13	5	Pass
NVNT	ax40	5270	Ant1	0.68	2.66	1.01	1.26	2.5	Pass
NVNT	ax40	5310	Ant1	0.69	2.66	1.03	1.27	2.5	Pass
NVNT	ax40	5510	Ant1	0.21	4.09	-2.68	0.54	12.5	Pass
NVNT	ax40	5590	Ant1	0.32	4.09	-0.84	0.82	12.5	Pass
NVNT	ax40	5670	Ant1	0.48	4.09	0.91	1.23	12.5	Pass

Occupied Channel Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	99% OBW (MHz)	Limit (MHz)	Verdict
NVNT	a	5180	Ant1	16.342	20	Pass
NVNT	a	5200	Ant1	16.346	20	Pass
NVNT	a	5240	Ant1	16.327	20	Pass
NVNT	a	5260	Ant1	16.502	20	Pass
NVNT	a	5300	Ant1	16.500	20	Pass
NVNT	a	5320	Ant1	16.496	20	Pass
NVNT	a	5500	Ant1	16.505	20	Pass
NVNT	a	5580	Ant1	16.506	20	Pass
NVNT	a	5700	Ant1	16.503	20	Pass
NVNT	n20	5180	Ant1	17.557	20	Pass
NVNT	n20	5200	Ant1	17.565	20	Pass
NVNT	n20	5240	Ant1	17.793	20	Pass
NVNT	n20	5260	Ant1	17.723	20	Pass
NVNT	n20	5300	Ant1	17.720	20	Pass
NVNT	n20	5320	Ant1	17.721	20	Pass
NVNT	n20	5500	Ant1	17.699	20	Pass
NVNT	n20	5580	Ant1	17.704	20	Pass
NVNT	n20	5700	Ant1	17.708	20	Pass
NVNT	n40	5190	Ant1	35.427	40	Pass
NVNT	n40	5200	Ant1	35.462	40	Pass
NVNT	n40	5230	Ant1	35.427	40	Pass
NVNT	n40	5270	Ant1	35.166	40	Pass
NVNT	n40	5310	Ant1	35.140	40	Pass
NVNT	n40	5510	Ant1	35.193	40	Pass
NVNT	n40	5590	Ant1	35.142	40	Pass
NVNT	n40	5670	Ant1	35.151	40	Pass
NVNT	ac20	5180	Ant1	17.843	20	Pass
NVNT	ac20	5200	Ant1	17.852	20	Pass
NVNT	ac20	5240	Ant1	17.860	20	Pass
NVNT	ac20	5260	Ant1	17.857	20	Pass
NVNT	ac20	5300	Ant1	17.843	20	Pass
NVNT	ac20	5320	Ant1	17.855	20	Pass
NVNT	ac20	5500	Ant1	17.843	20	Pass
NVNT	ac20	5580	Ant1	17.836	20	Pass
NVNT	ac20	5700	Ant1	17.833	20	Pass
NVNT	ac40	5190	Ant1	35.851	40	Pass
NVNT	ac40	5200	Ant1	35.862	40	Pass
NVNT	ac40	5230	Ant1	35.818	40	Pass
NVNT	ac40	5270	Ant1	35.866	40	Pass
NVNT	ac40	5310	Ant1	35.816	40	Pass
NVNT	ac40	5510	Ant1	35.194	40	Pass

NVNT	ac40	5590	Ant1	35.140	40	Pass
NVNT	ac40	5670	Ant1	35.148	40	Pass
NVNT	ax20	5180	Ant1	18.852	20	Pass
NVNT	ax20	5200	Ant1	19.007	20	Pass
NVNT	ax20	5240	Ant1	19.028	20	Pass
NVNT	ax20	5260	Ant1	19.008	20	Pass
NVNT	ax20	5300	Ant1	19.005	20	Pass
NVNT	ax20	5320	Ant1	18.996	20	Pass
NVNT	ax20	5500	Ant1	19.013	20	Pass
NVNT	ax20	5580	Ant1	19.012	20	Pass
NVNT	ax20	5700	Ant1	19.023	20	Pass
NVNT	ax40	5190	Ant1	37.512	40	Pass
NVNT	ax40	5200	Ant1	37.514	40	Pass
NVNT	ax40	5230	Ant1	37.507	40	Pass
NVNT	ax40	5270	Ant1	37.516	40	Pass
NVNT	ax40	5310	Ant1	37.488	40	Pass
NVNT	ax40	5510	Ant1	36.995	40	Pass
NVNT	ax40	5590	Ant1	36.929	40	Pass
NVNT	ax40	5670	Ant1	36.903	40	Pass


Test Graphs
OBW NVNT a 5180MHz Ant1

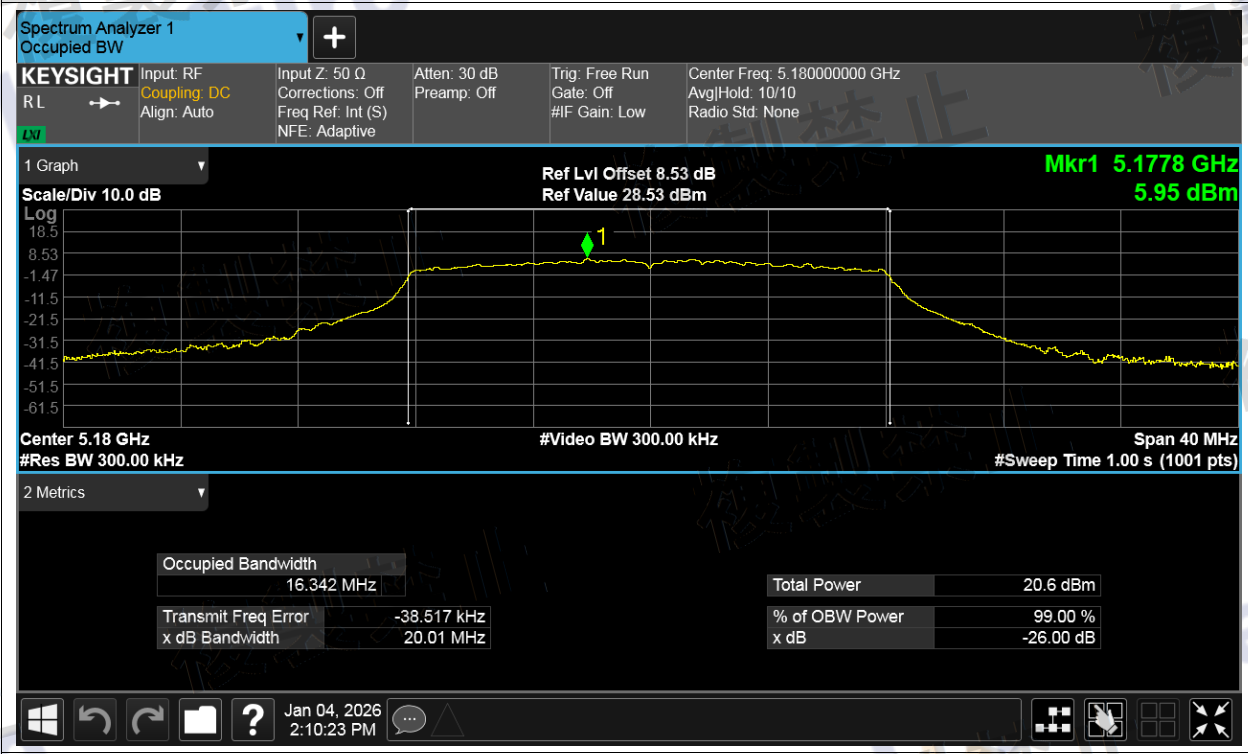


OBW NVNT a 5200MHz Ant1

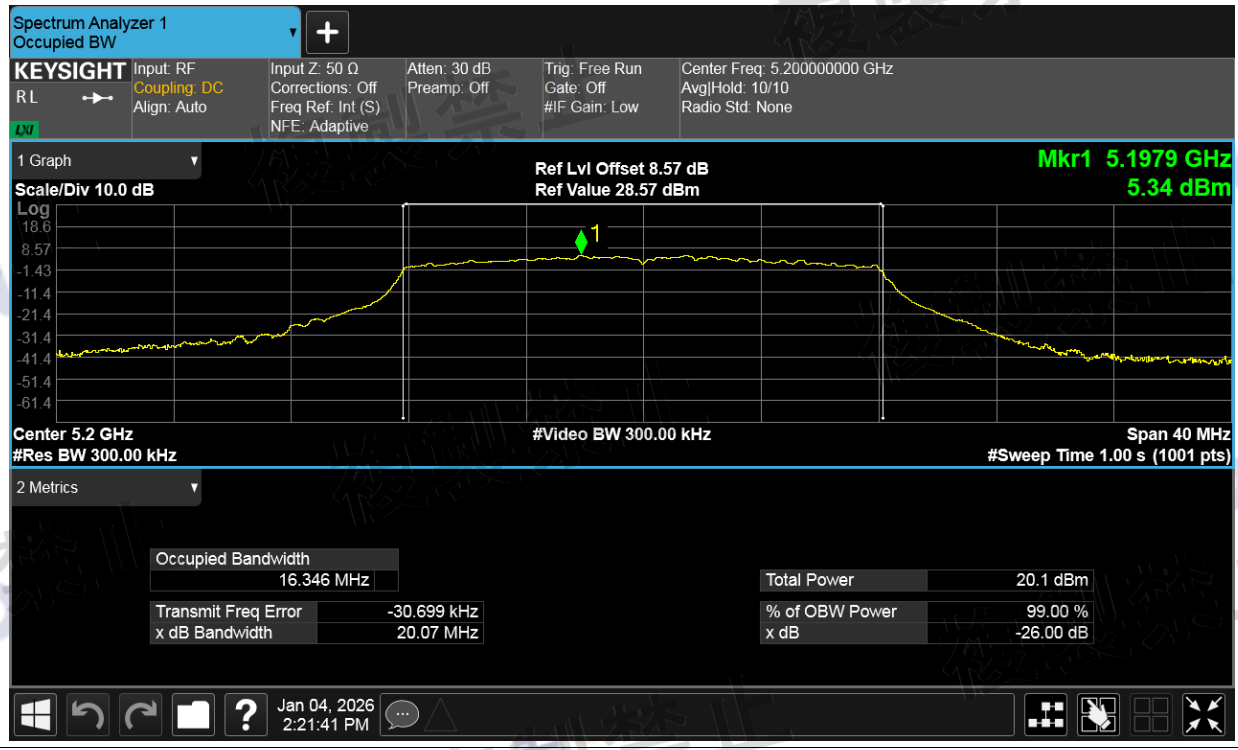


OBW NVNT a 5240MHz Ant1

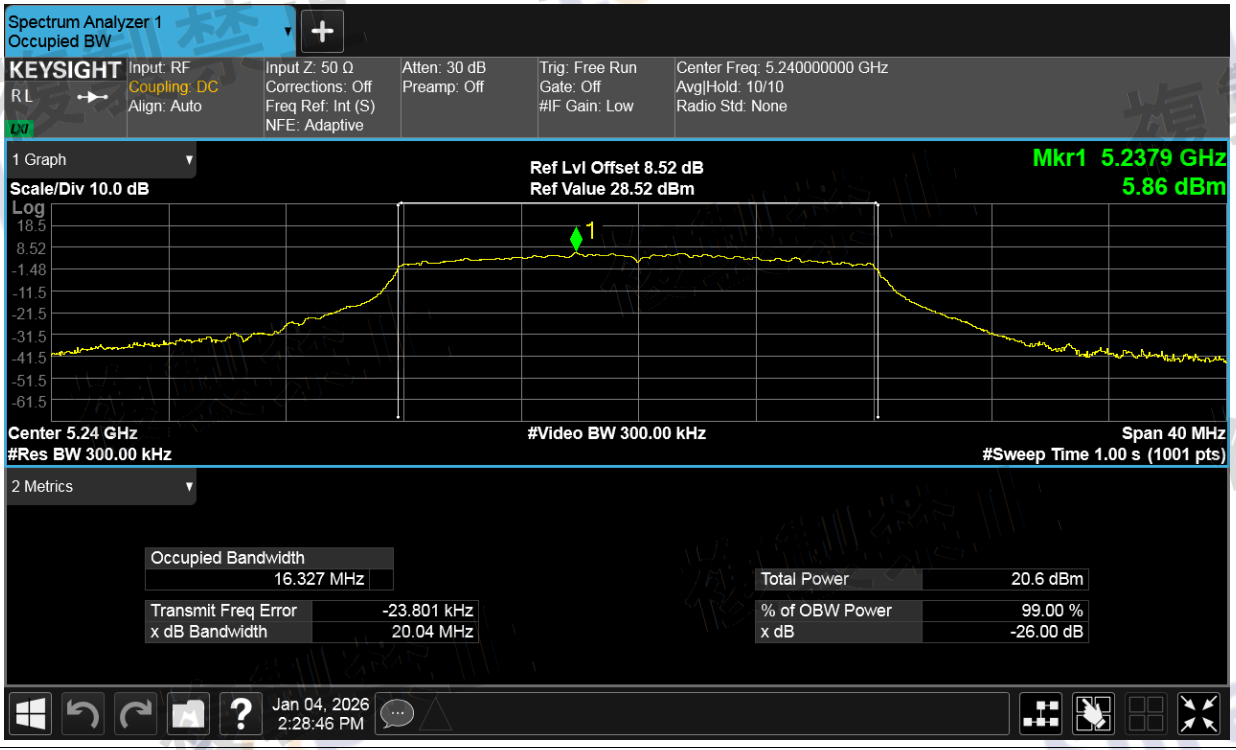


OBW NVNT a 5260MHz Ant1

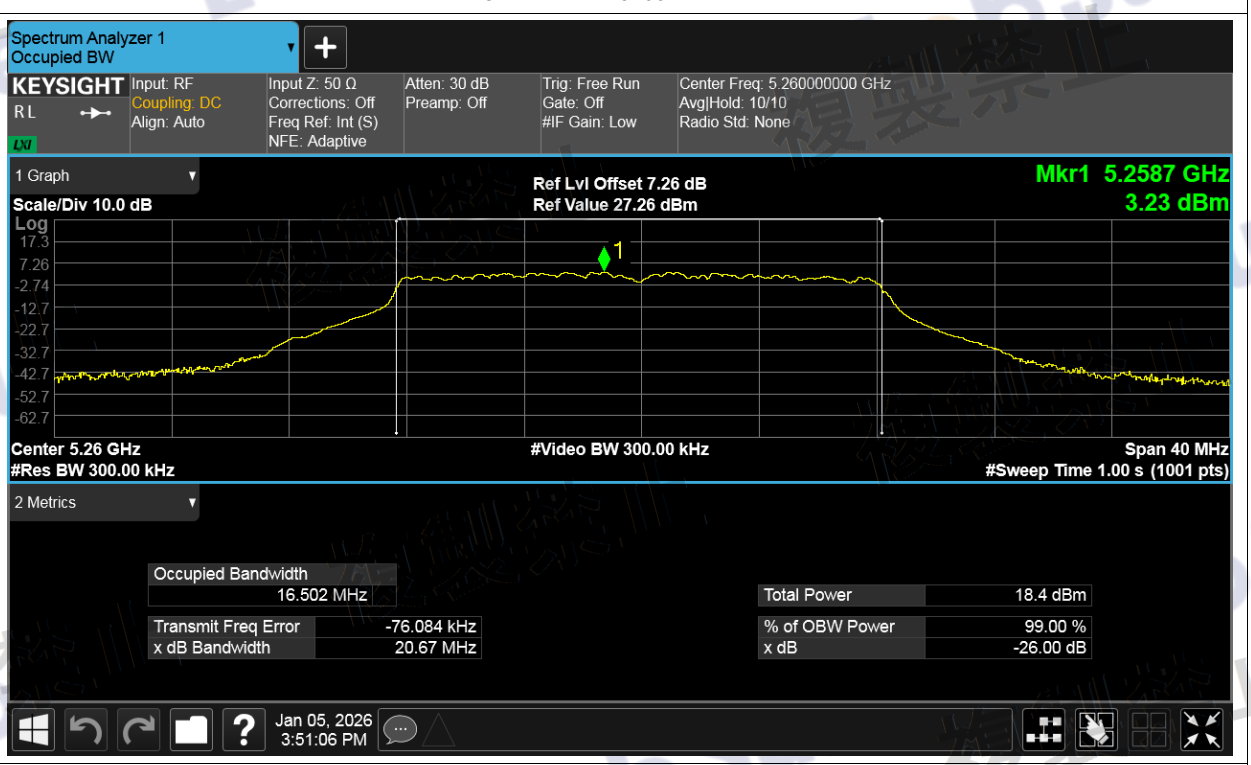


OBW NVNT a 5300MHz Ant1

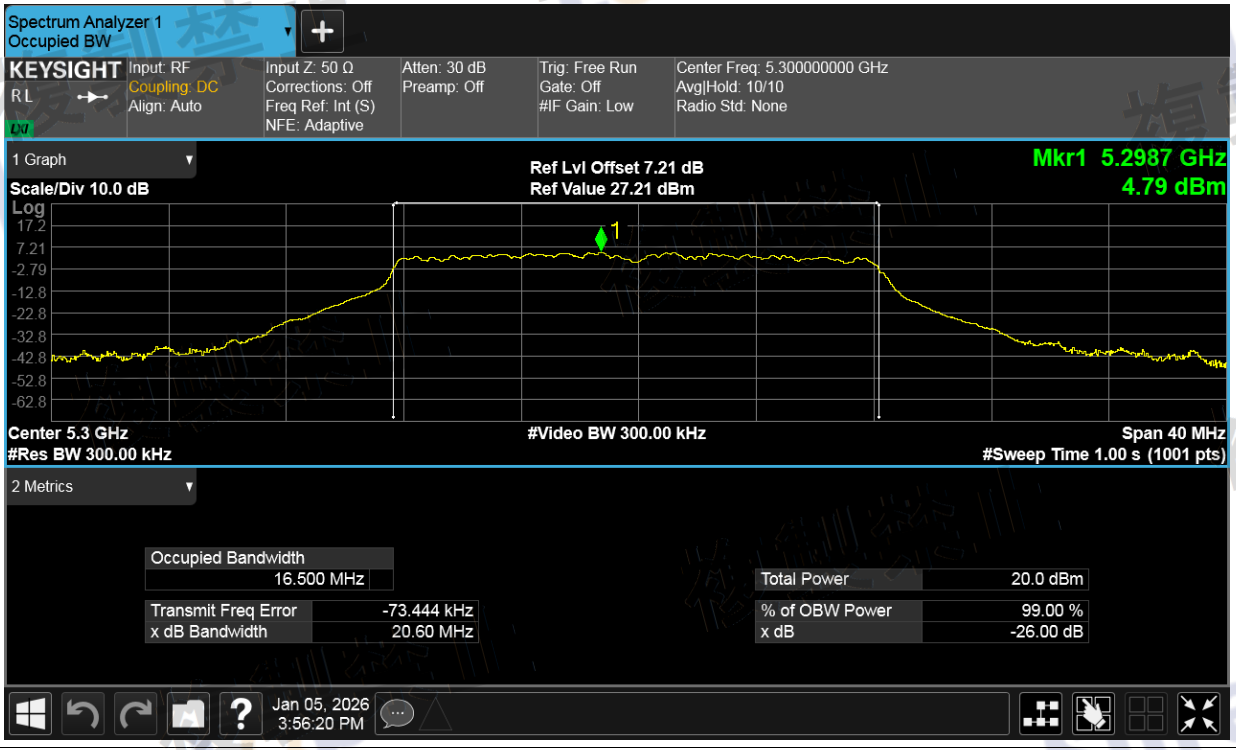


OBW NVNT a 5320MHz Ant1

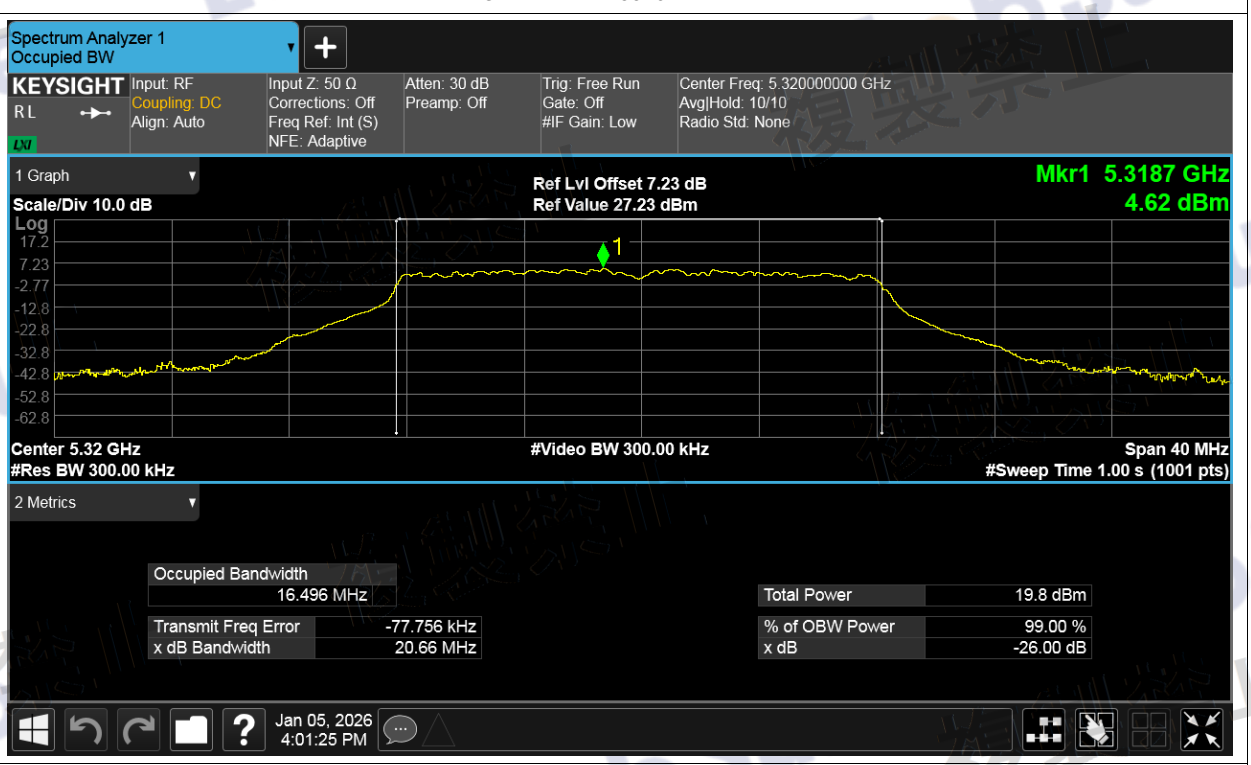


OBW NVNT a 5500MHz Ant1

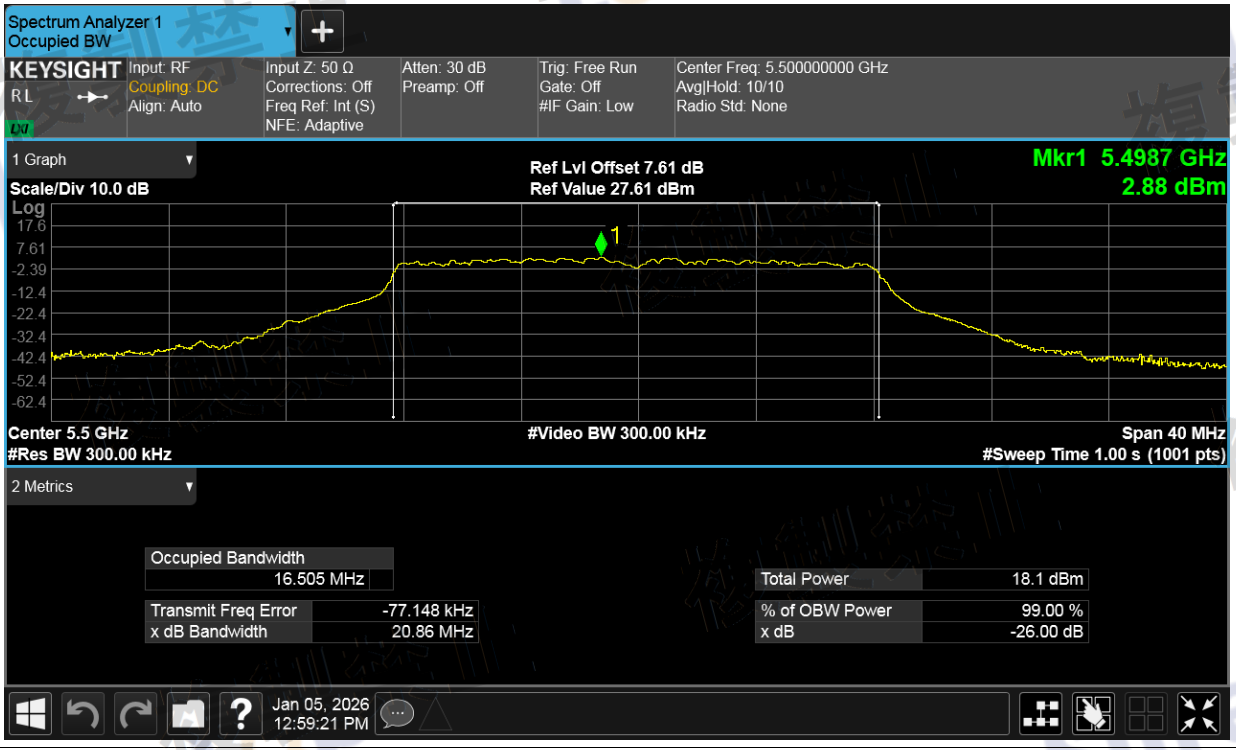


OBW NVNT a 5580MHz Ant1

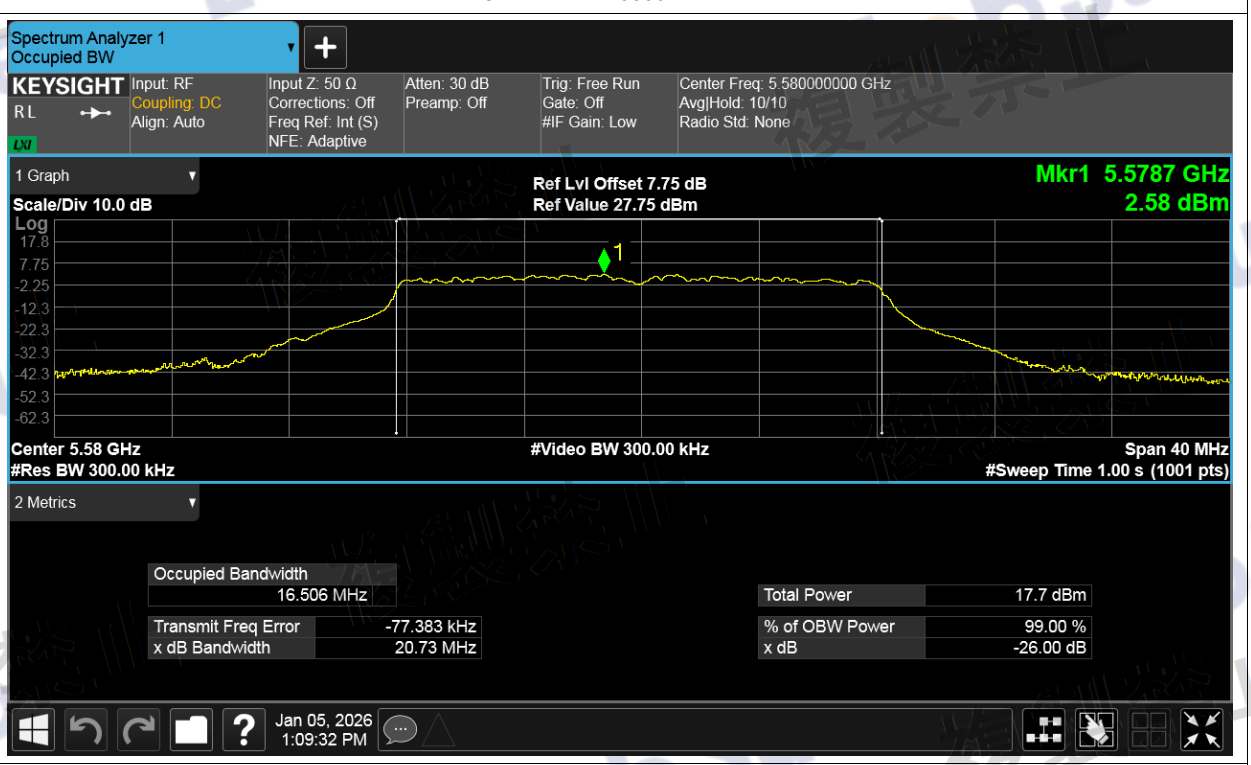


OBW NVNT a 5700MHz Ant1

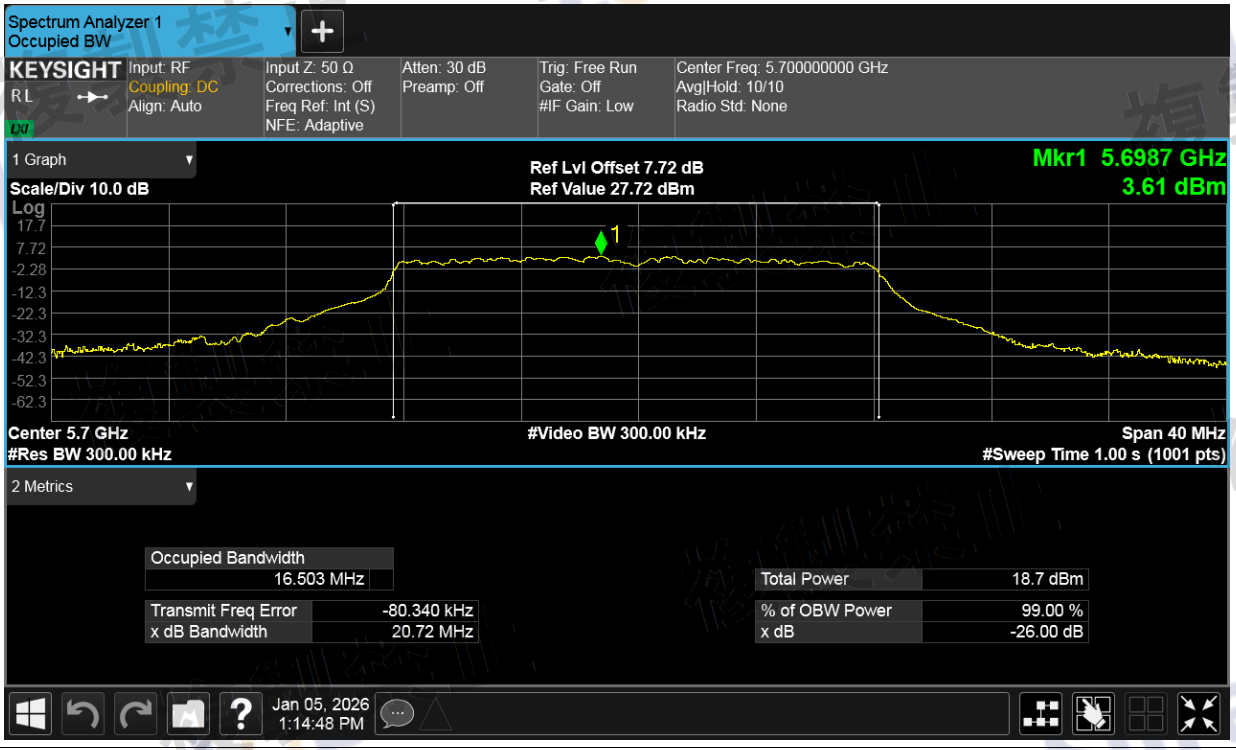


OBW NVNT n20 5180MHz Ant1

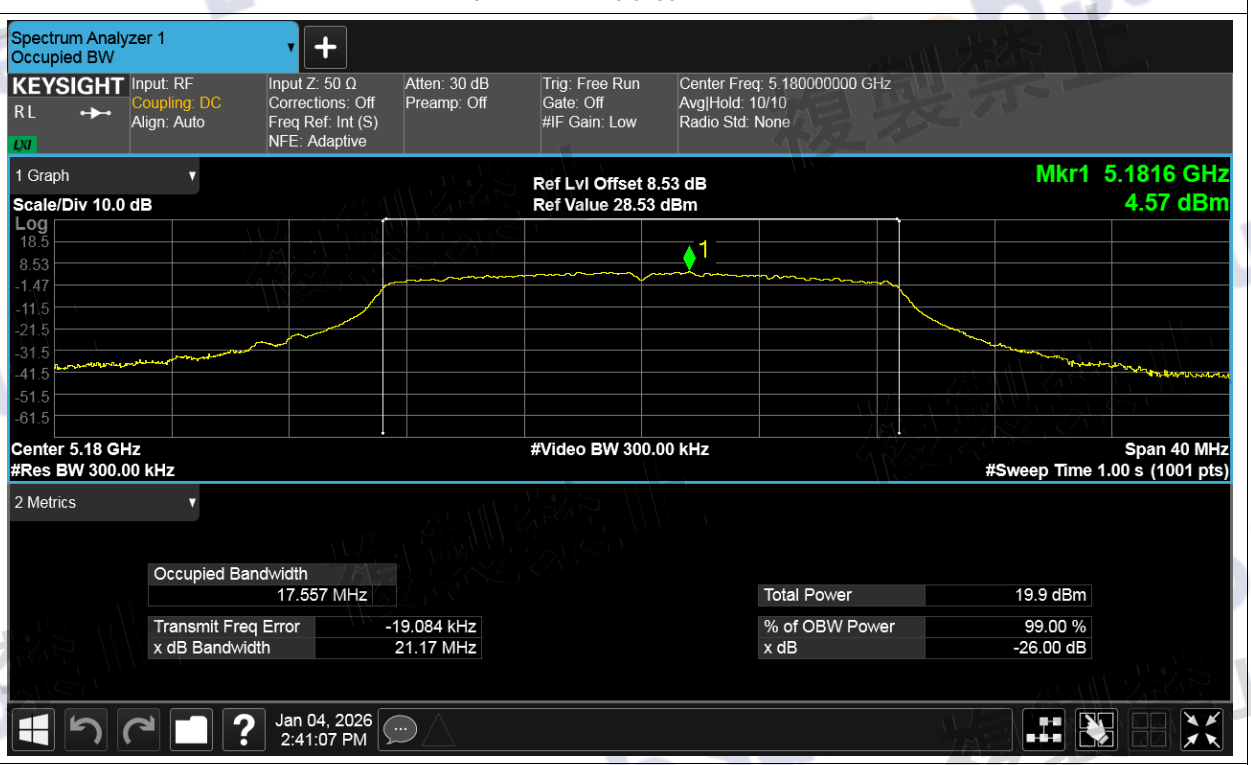


OBW NVNT n20 5200MHz Ant1

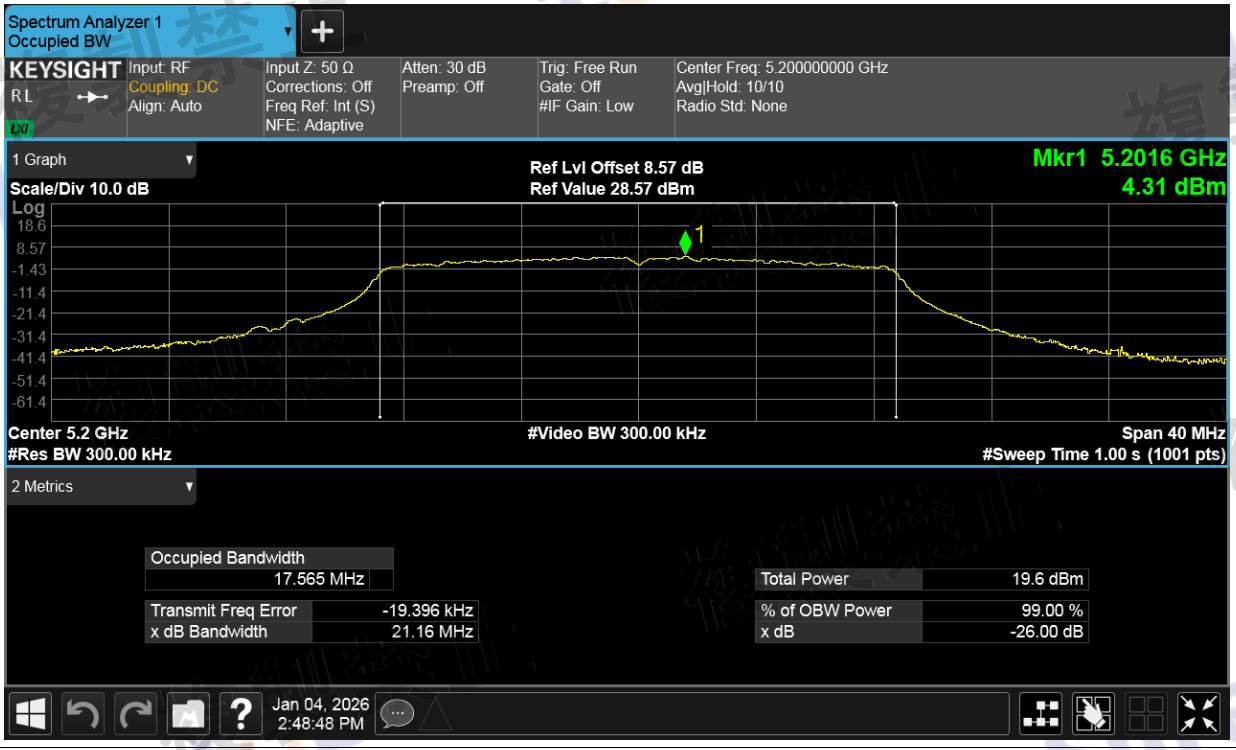


OBW NVNT n20 5240MHz Ant1

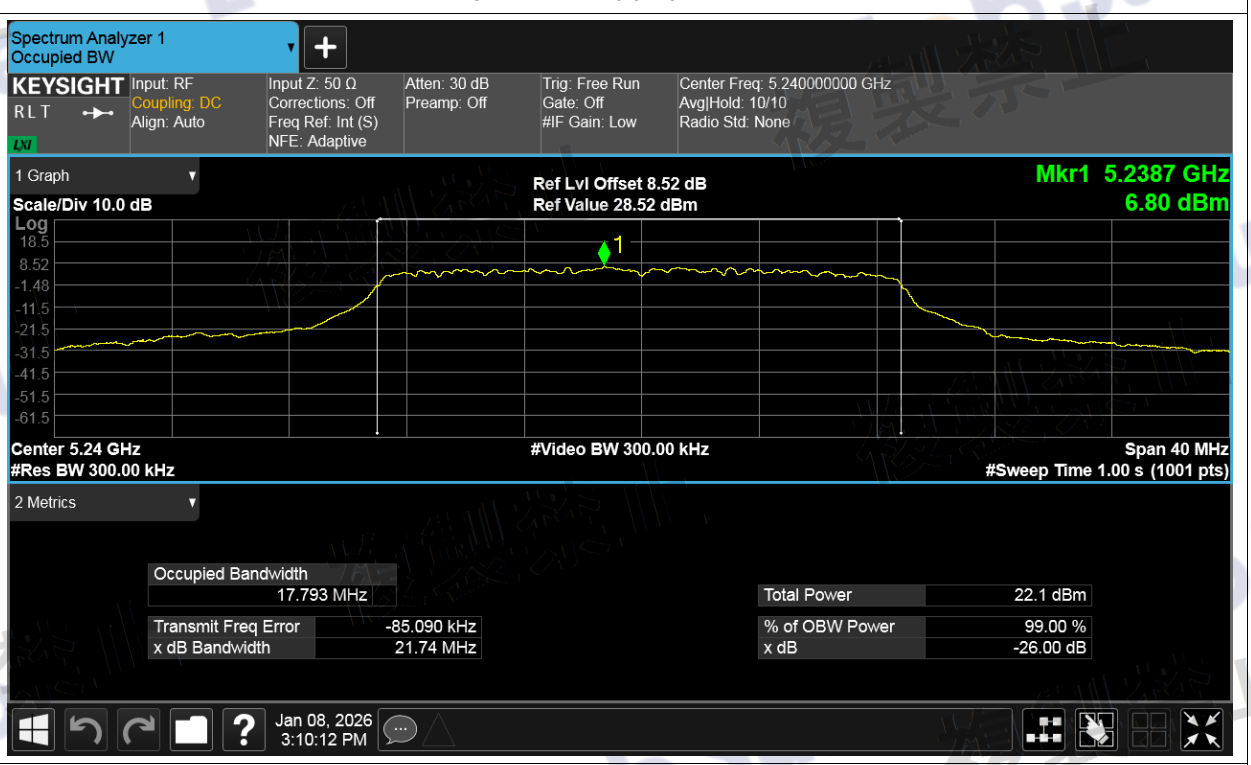


OBW NVNT n20 5260MHz Ant1

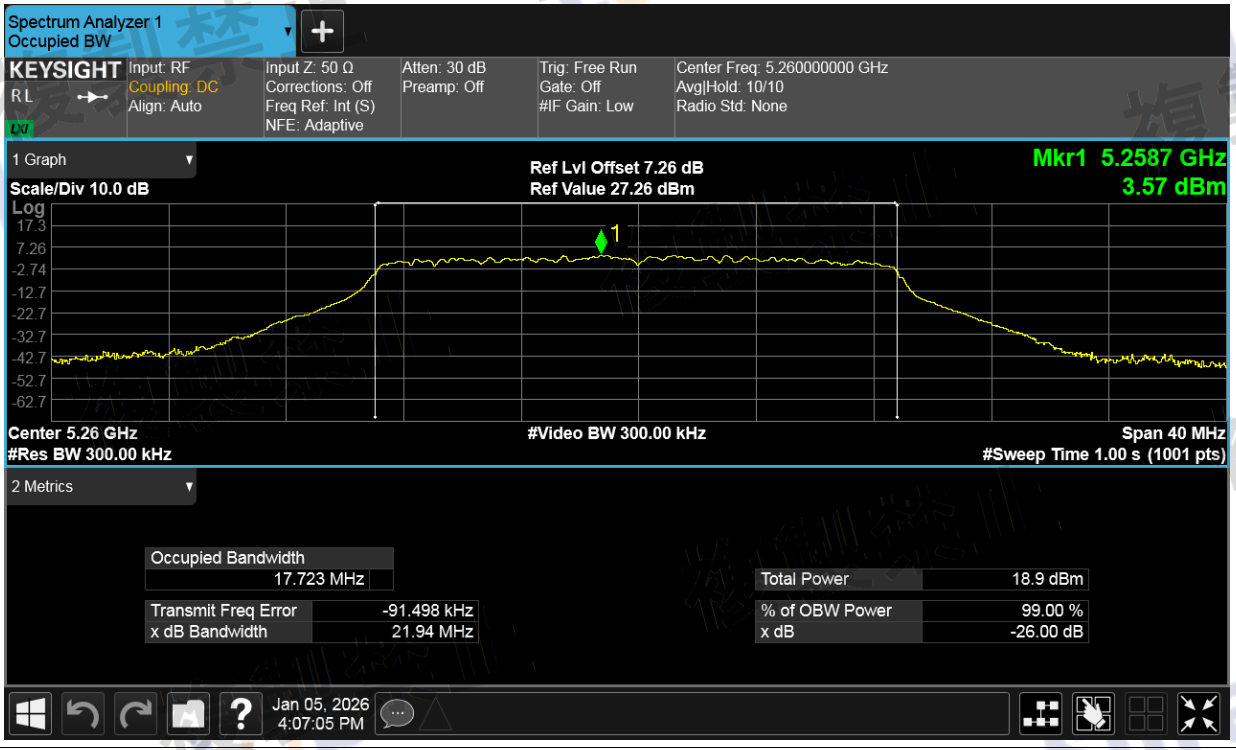


OBW NVNT n20 5300MHz Ant1

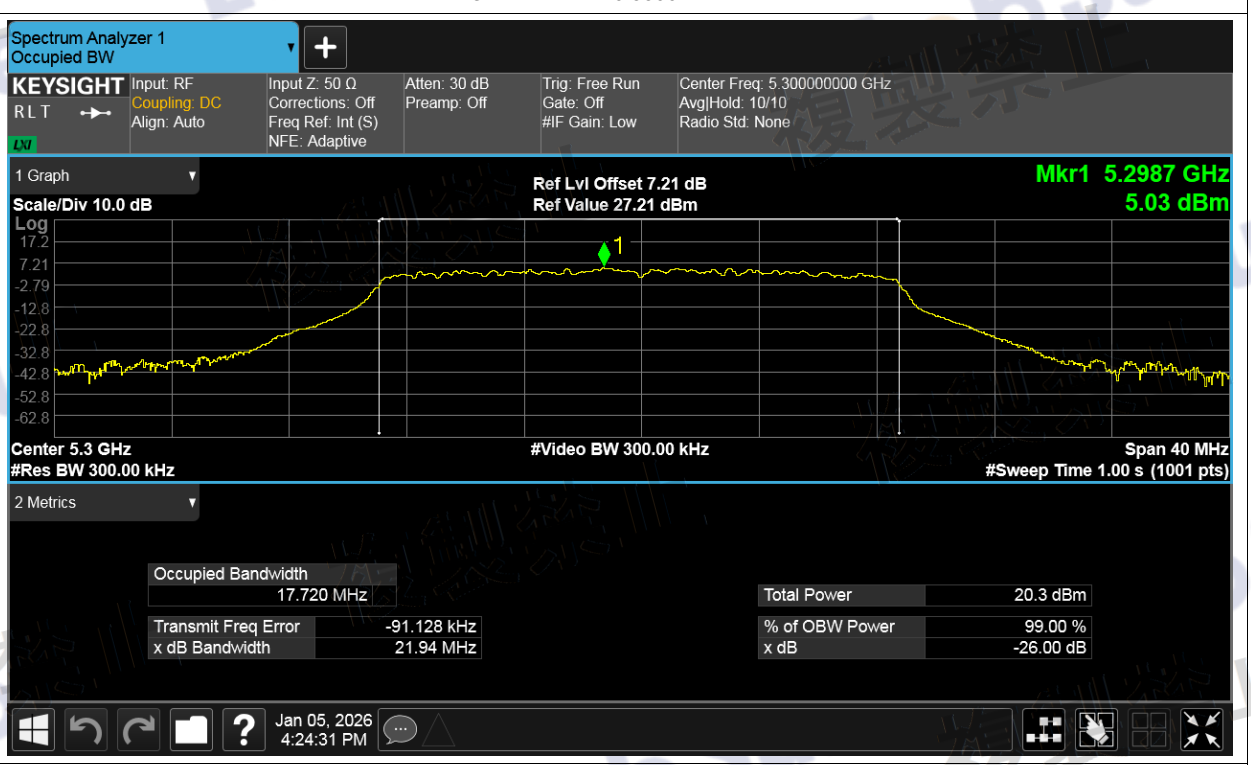


OBW NVNT n20 5320MHz Ant1

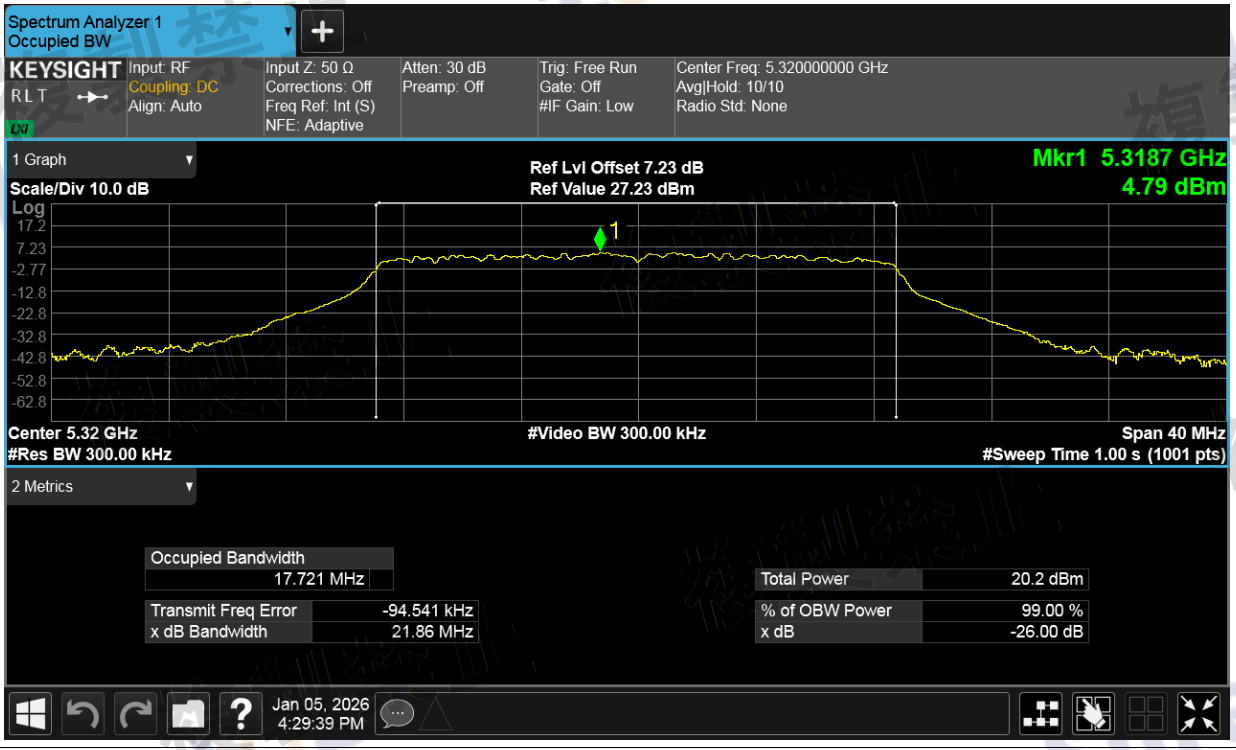


OBW NVNT n20 5500MHz Ant1

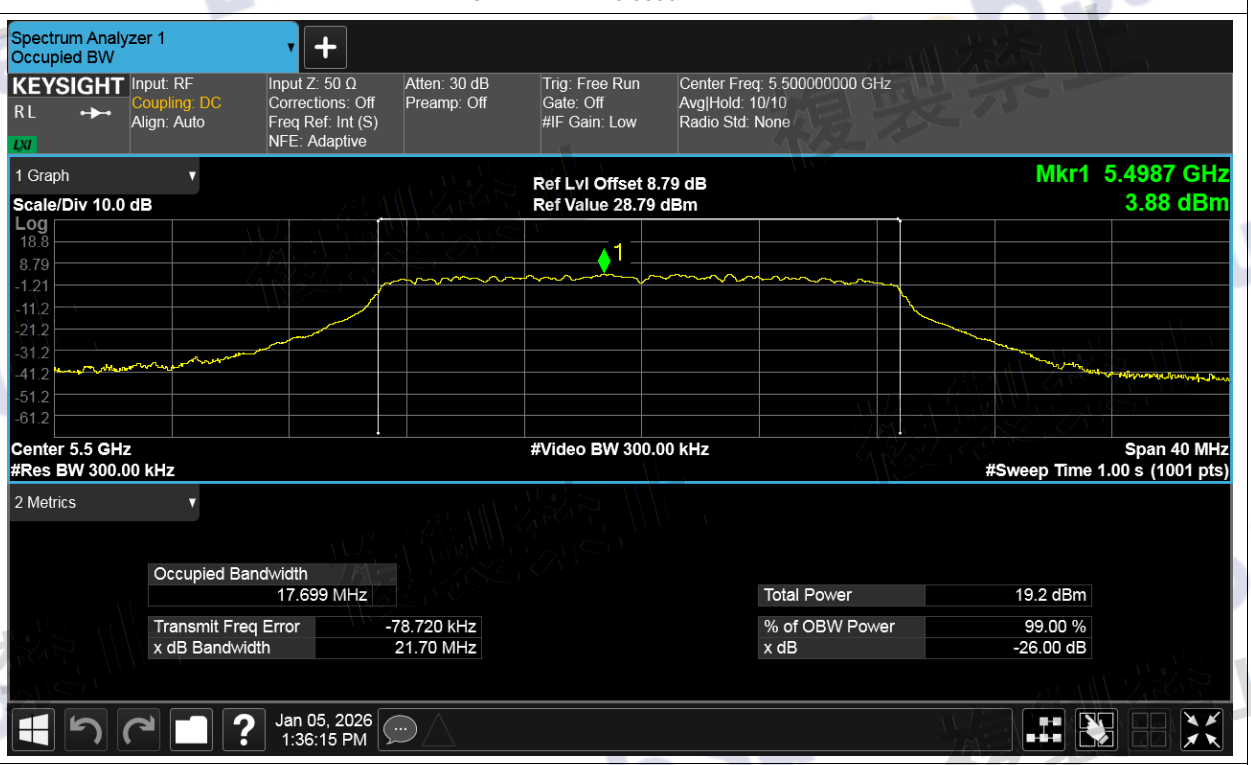


OBW NVNT n20 5580MHz Ant1

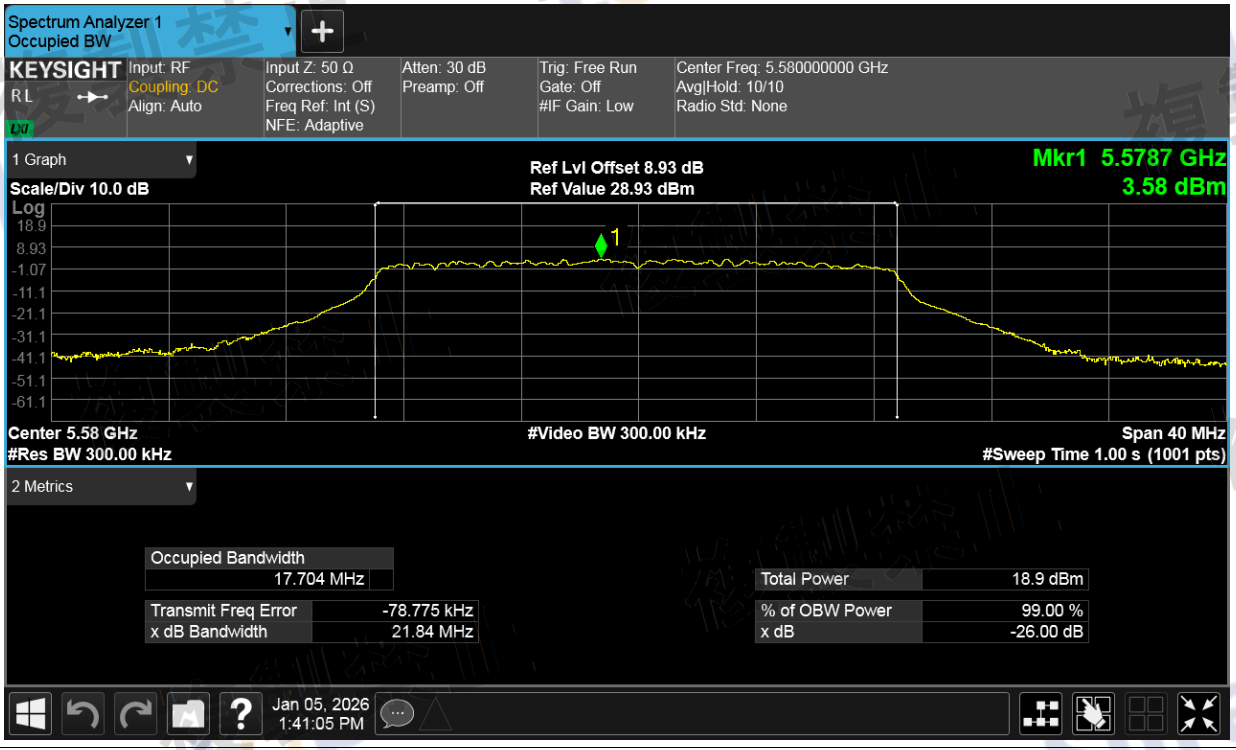


OBW NVNT n20 5700MHz Ant1

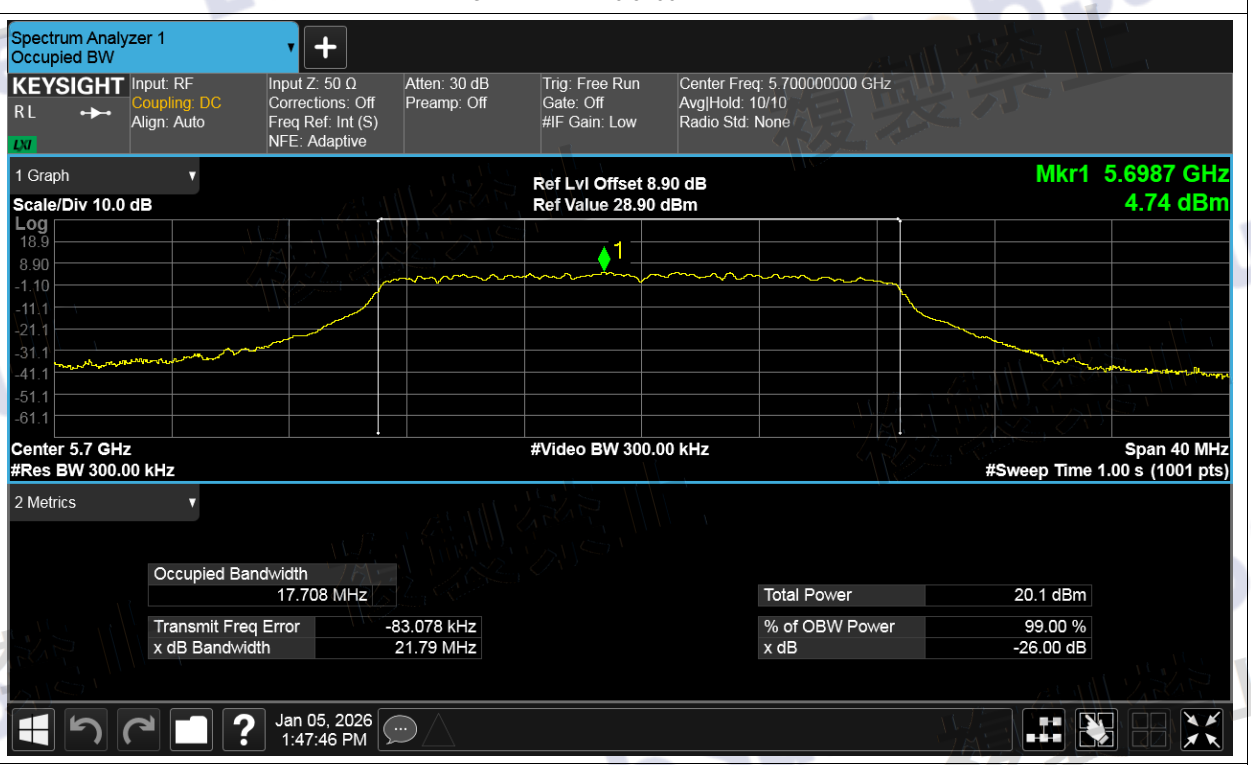

OBW NVNT n40 5190MHz Ant1

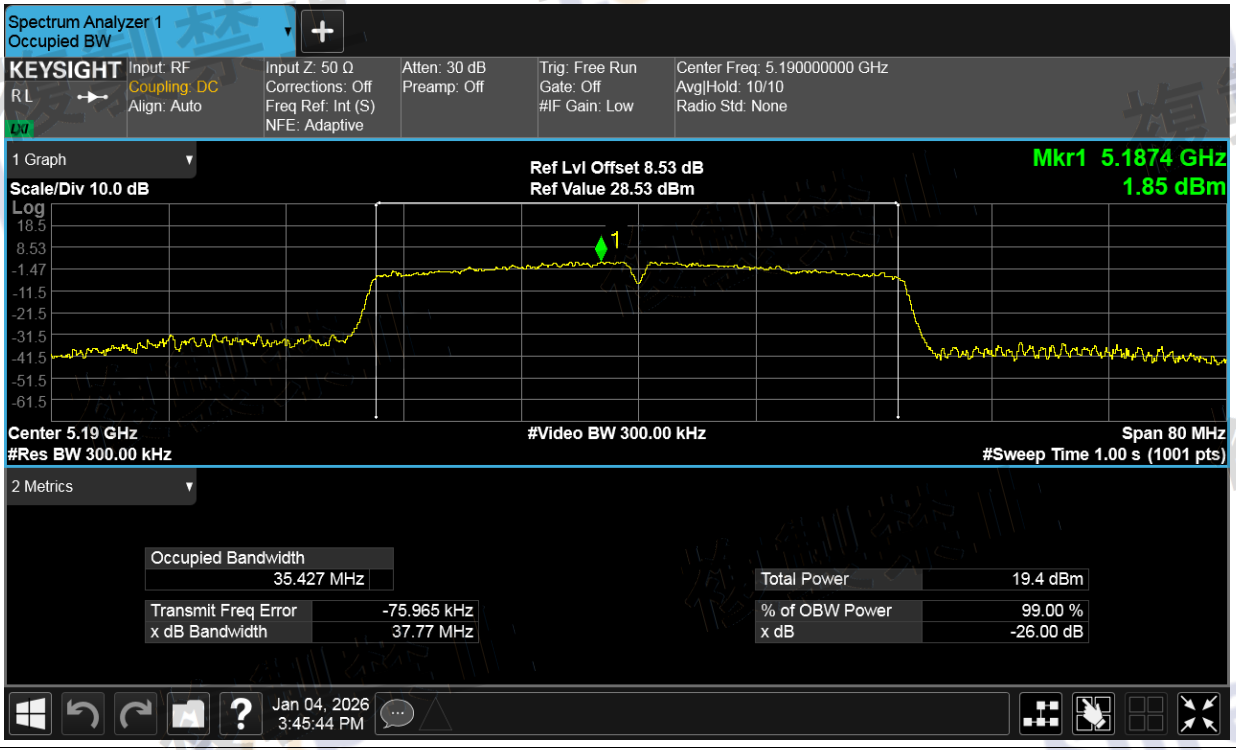


OBW NVNT n40 5200MHz Ant1

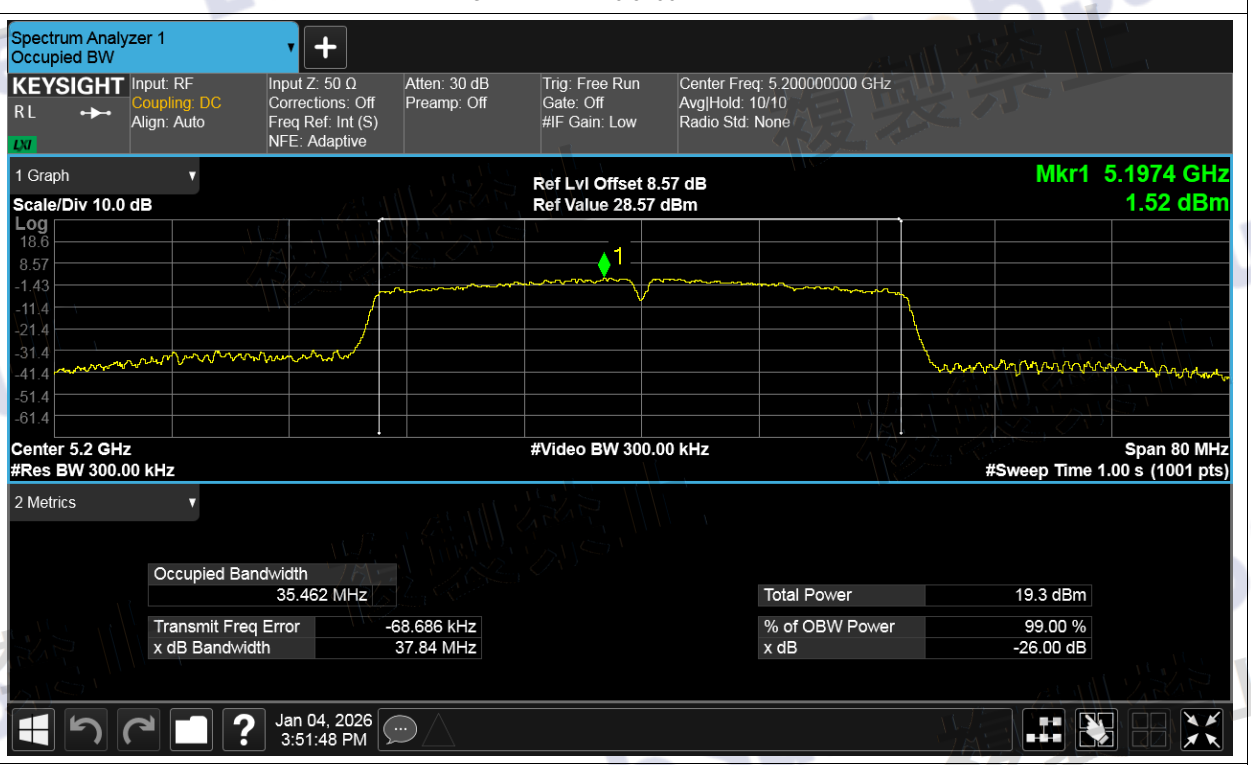


OBW NVNT n40 5230MHz Ant1



OBW NVNT n40 5270MHz Ant1

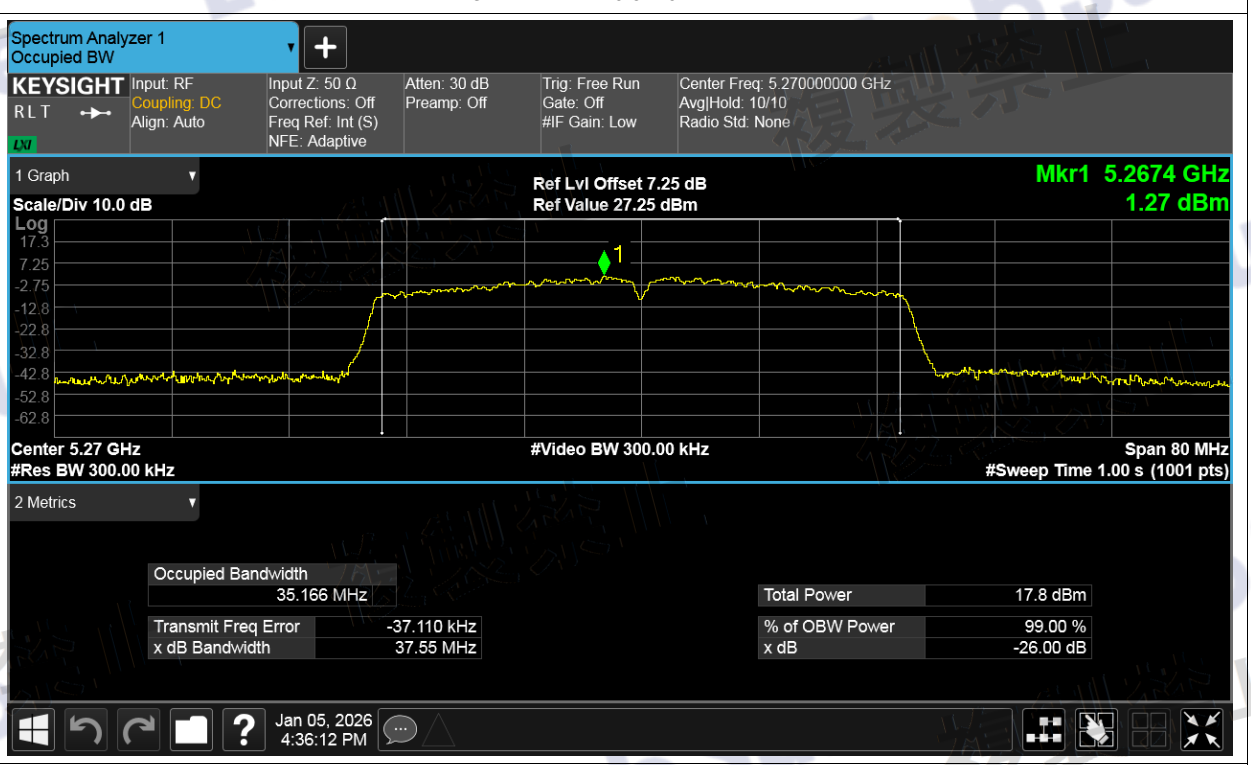

OBW NVNT n40 5310MHz Ant1

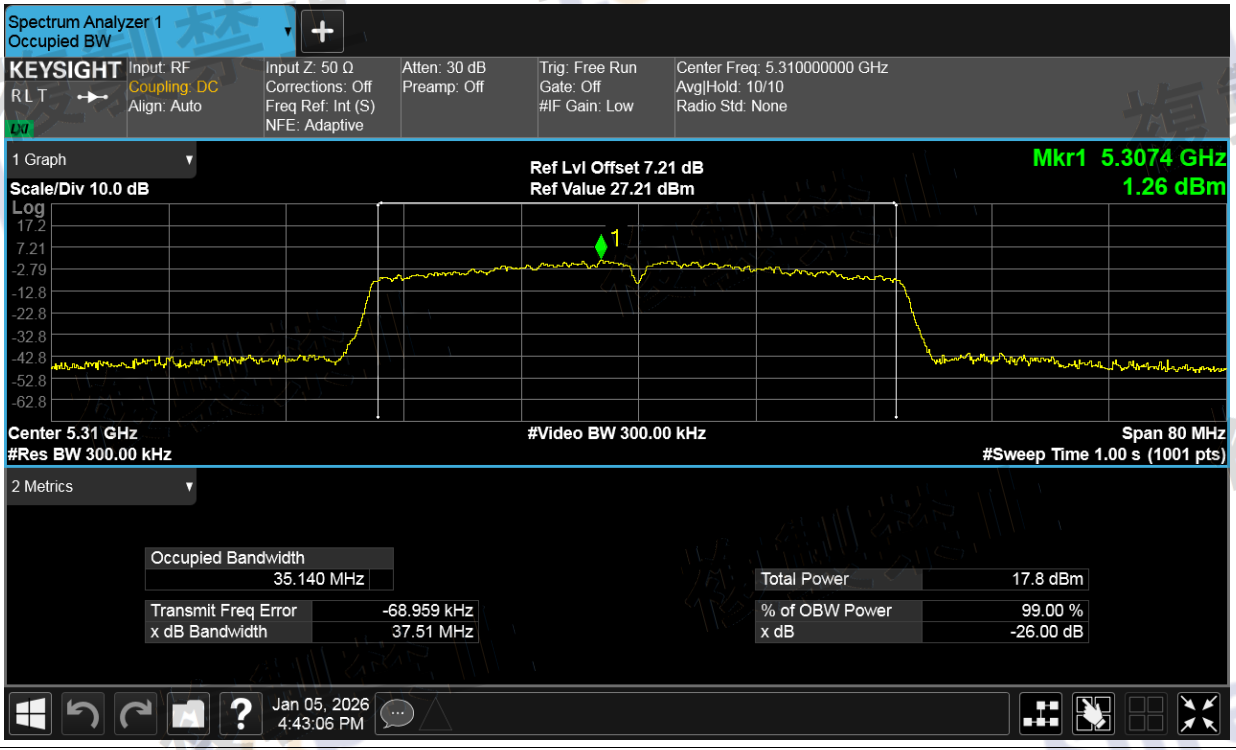


OBW NVNT n40 5510MHz Ant1




OBW NVNT n40 5590MHz Ant1




OBW NVNT n40 5670MHz Ant1

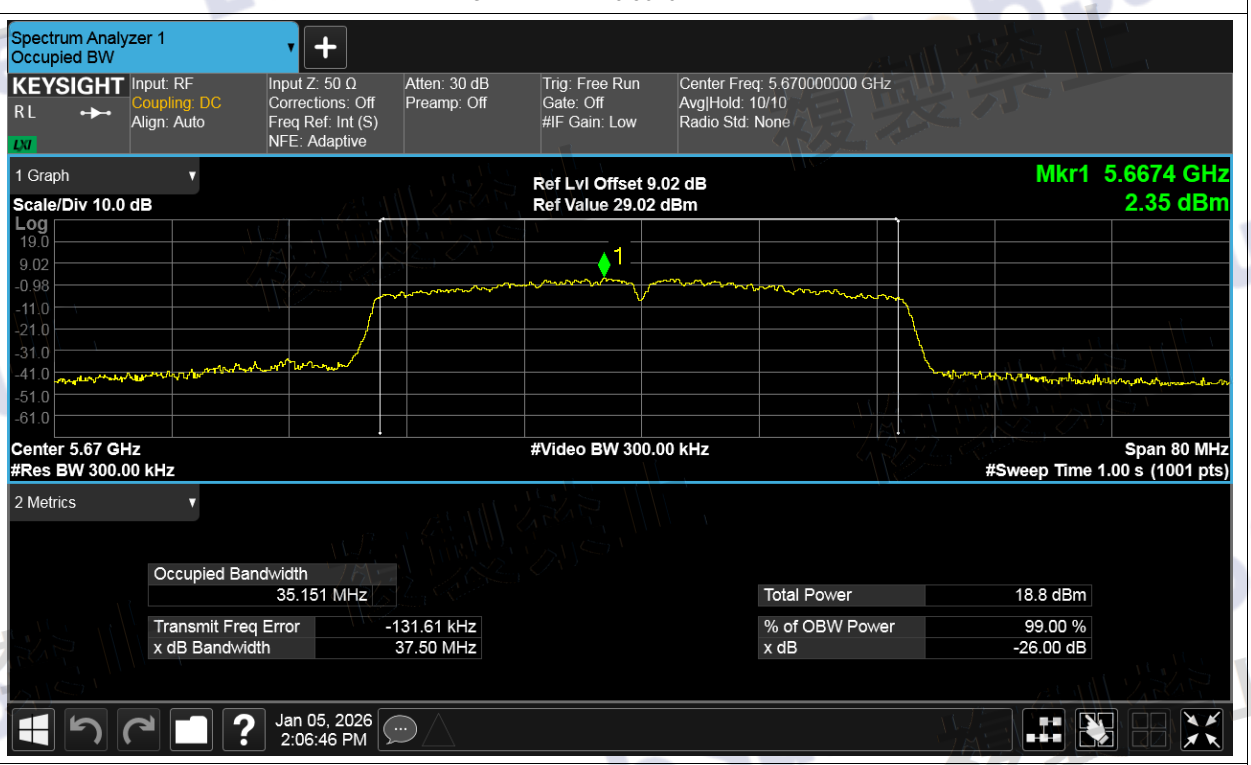


OBW NVNT ac20 5180MHz Ant1

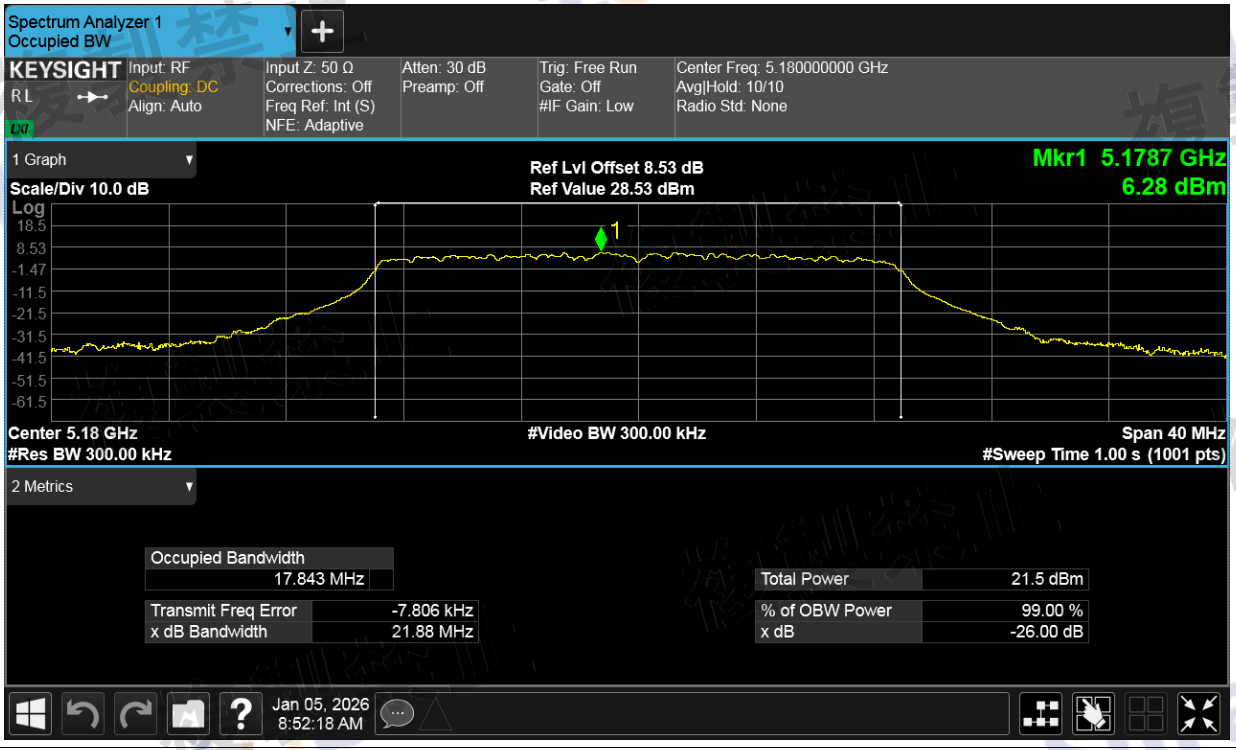


OBW NVNT ac20 5200MHz Ant1

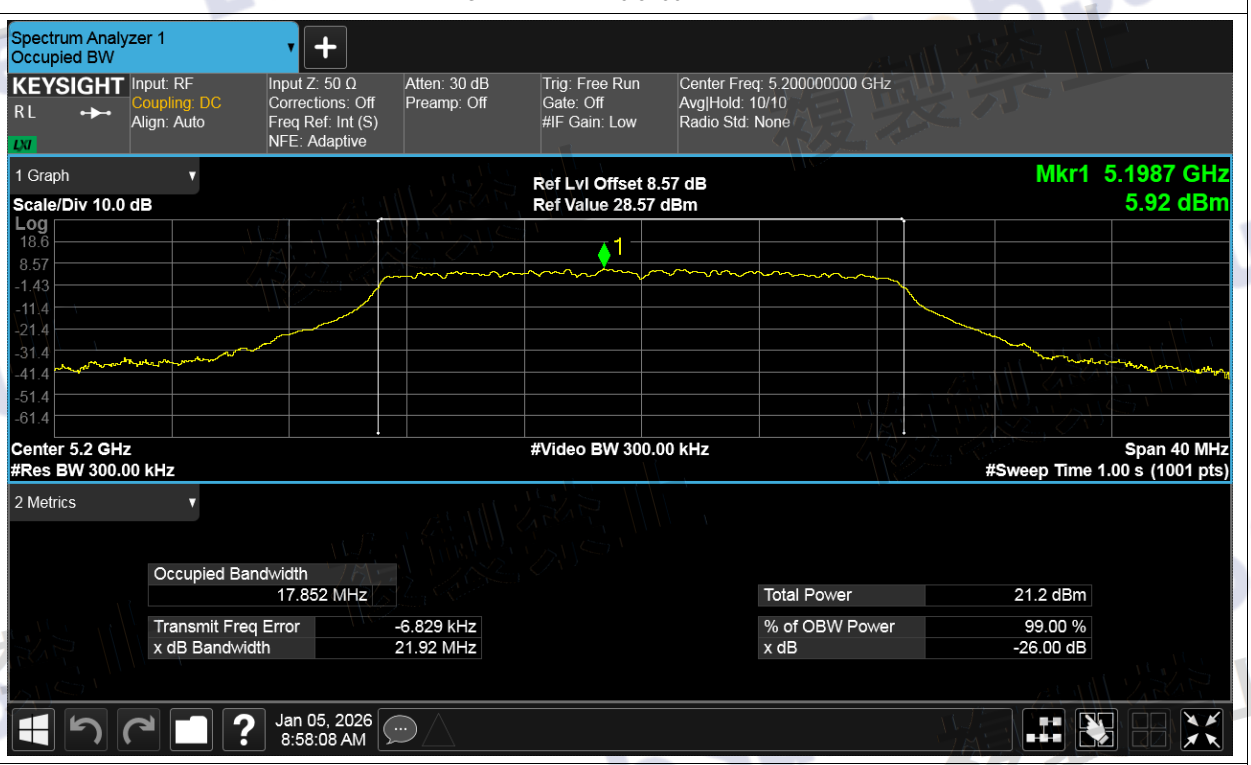


OBW NVNT ac20 5240MHz Ant1

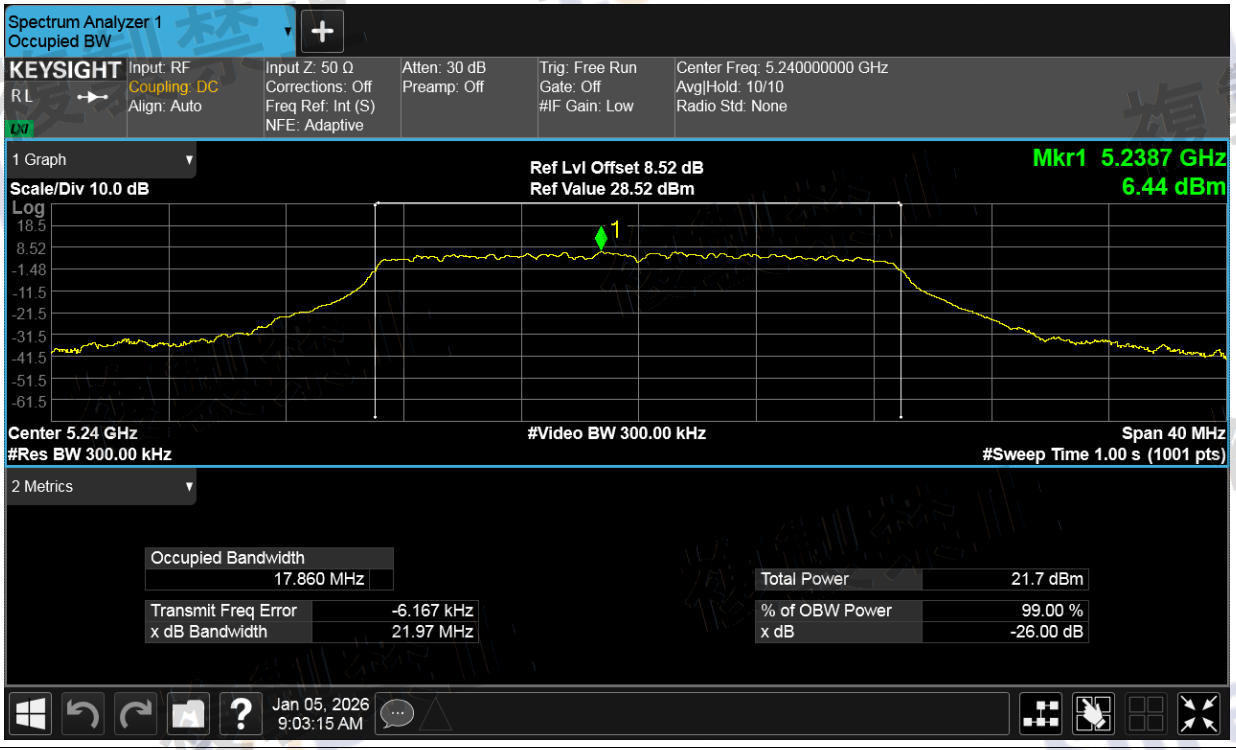


OBW NVNT ac20 5260MHz Ant1

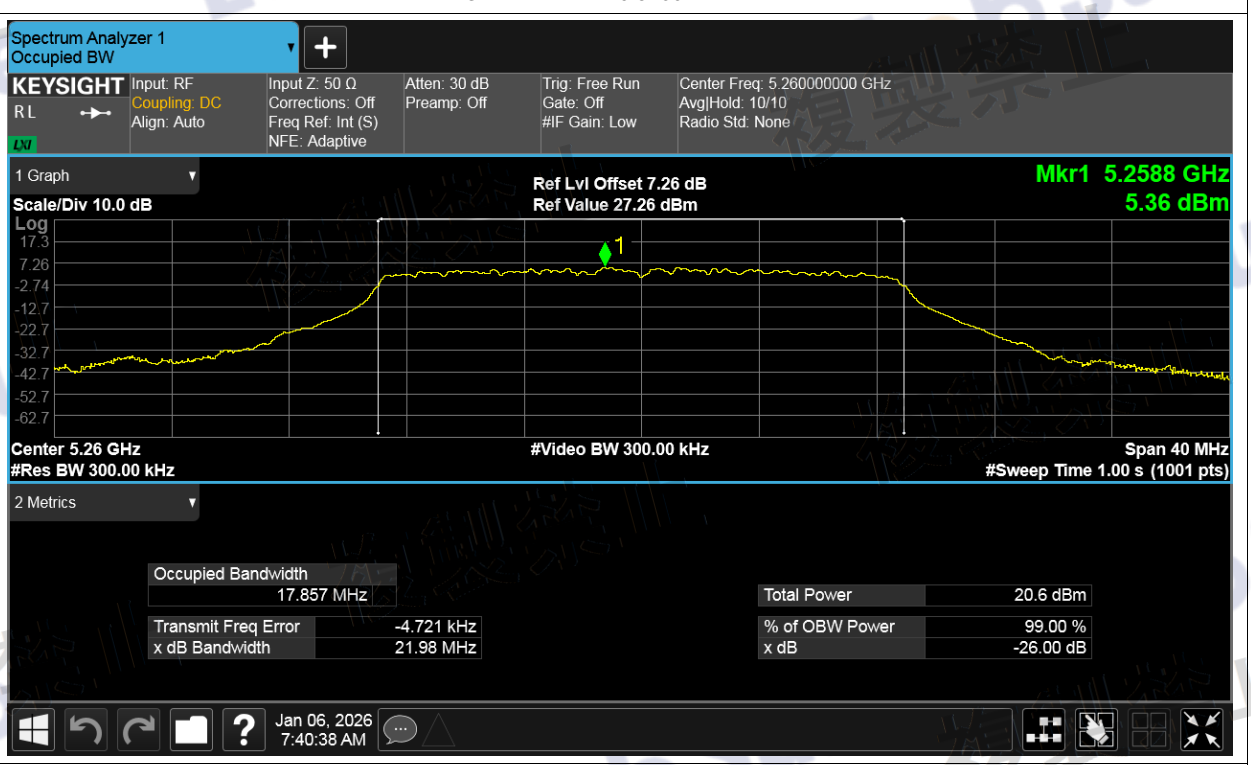


OBW NVNT ac20 5300MHz Ant1

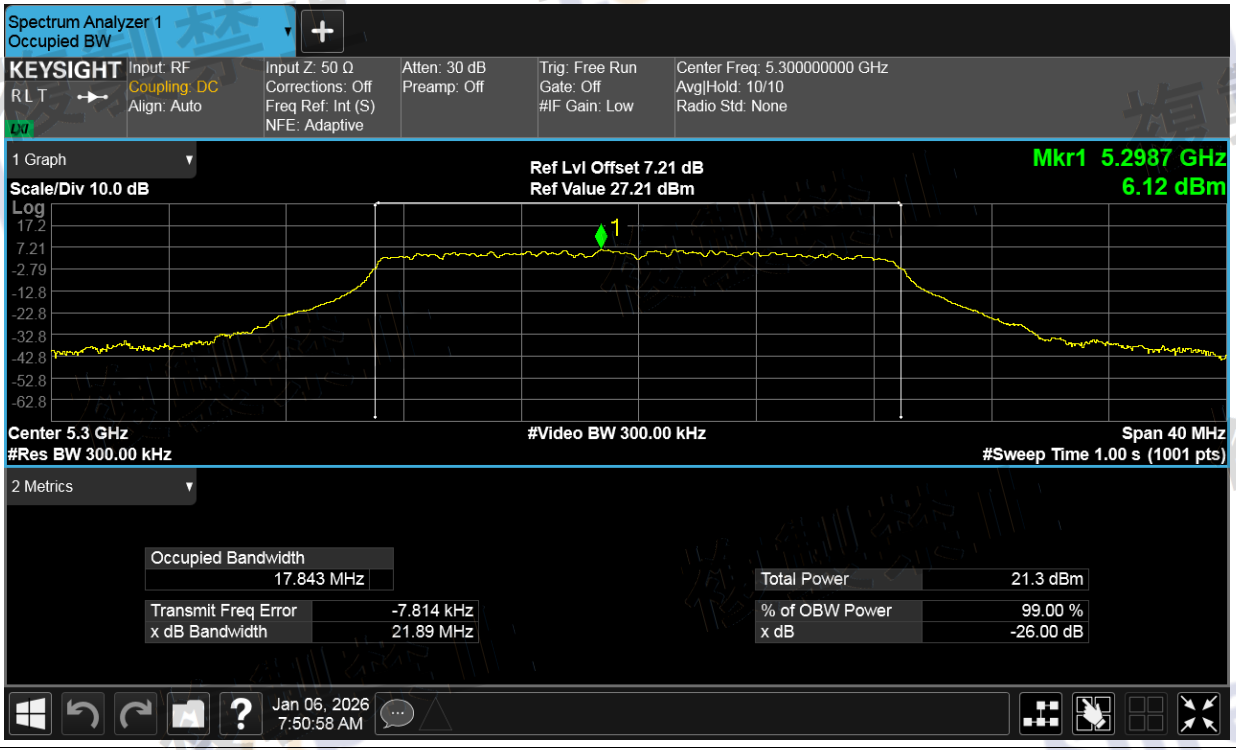


OBW NVNT ac20 5320MHz Ant1

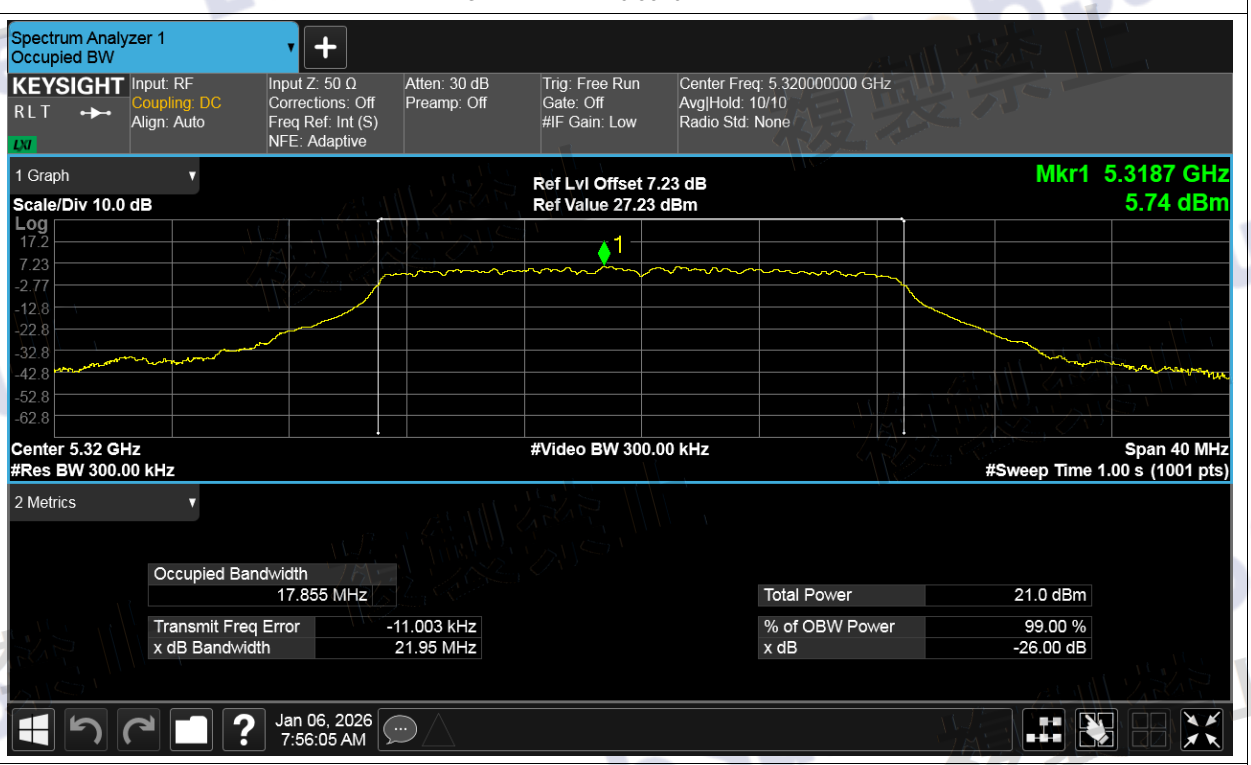


OBW NVNT ac20 5500MHz Ant1

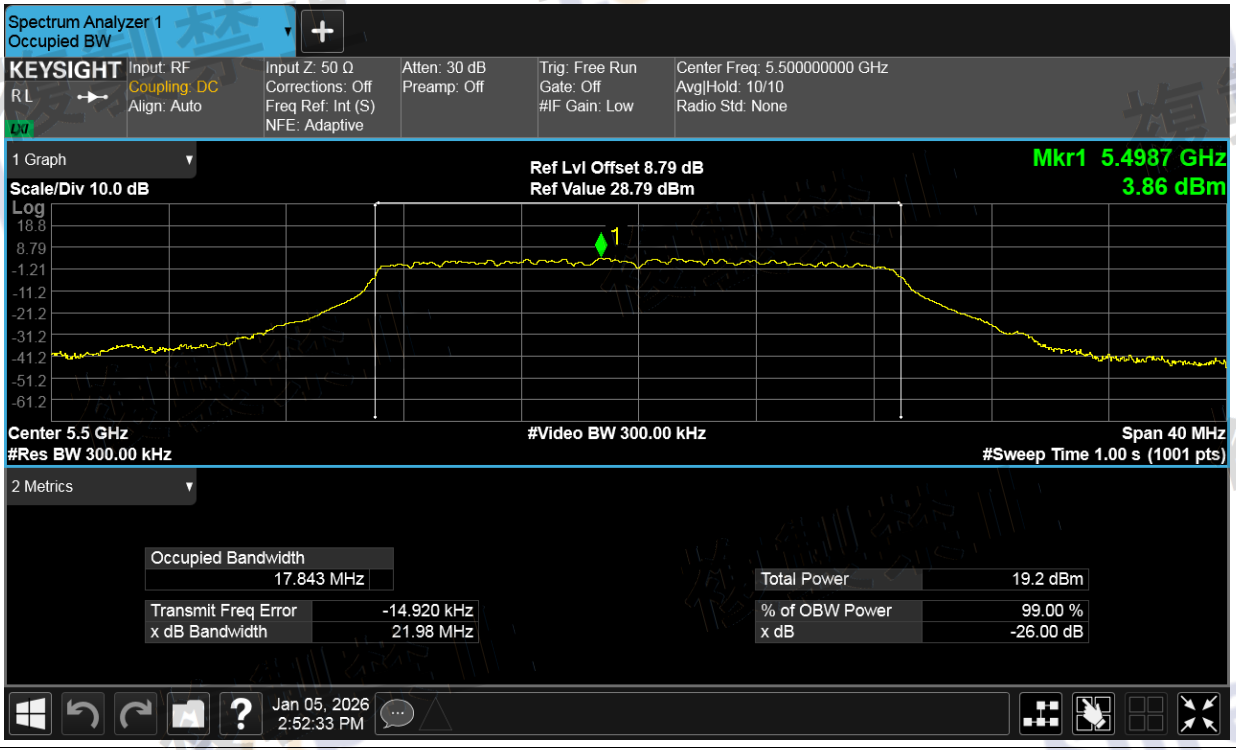

OBW NVNT ac20 5580MHz Ant1

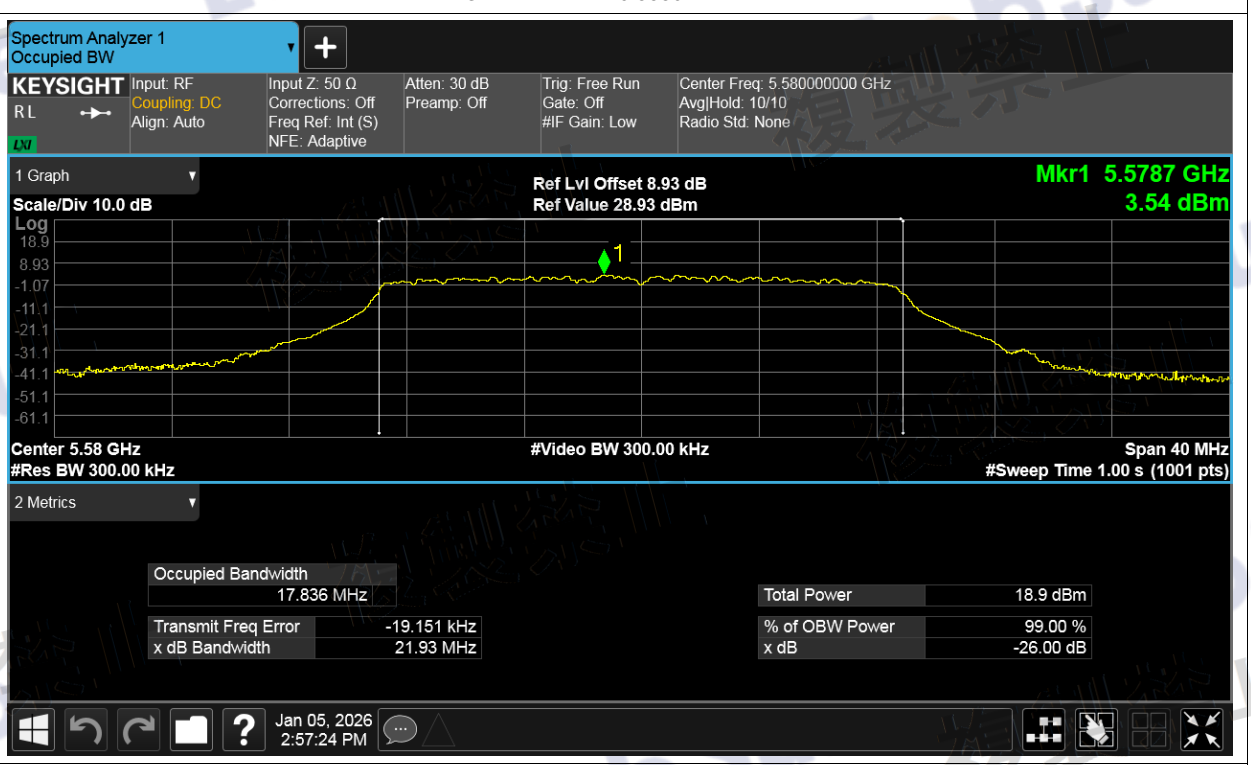


OBW NVNT ac20 5700MHz Ant1

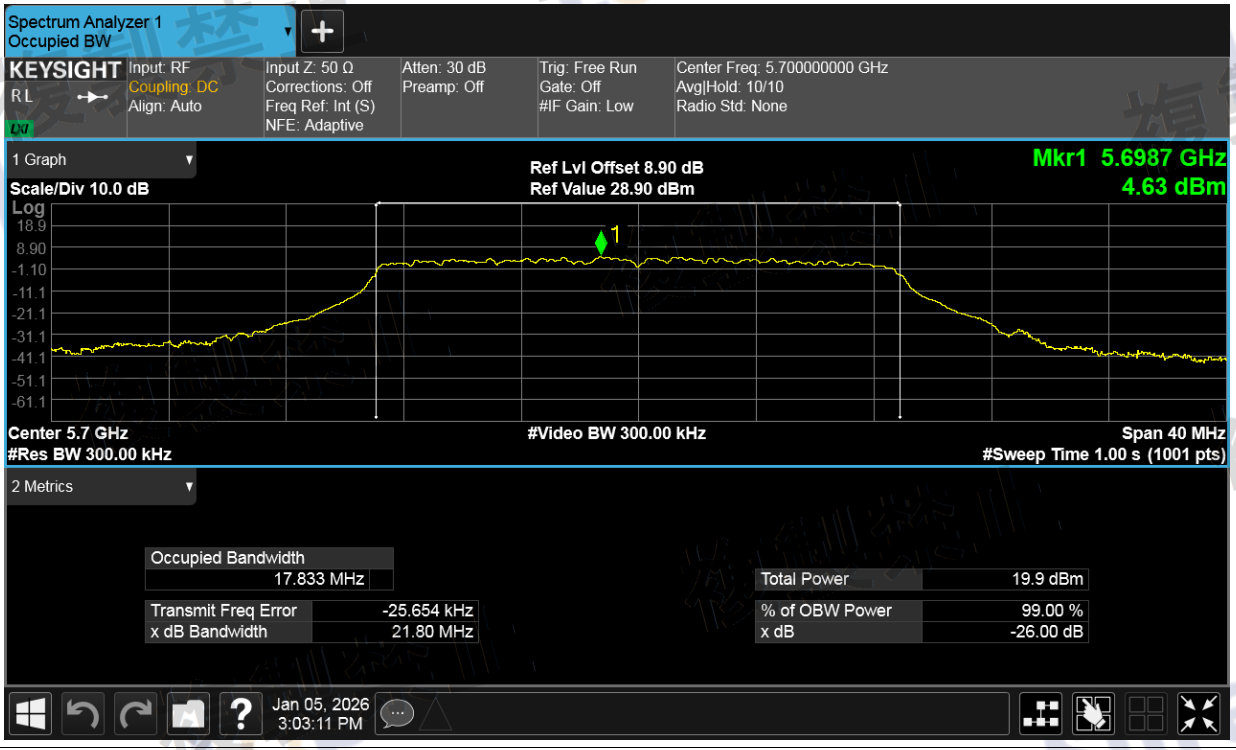

OBW NVNT ac40 5190MHz Ant1




OBW NVNT ac40 5200MHz Ant1

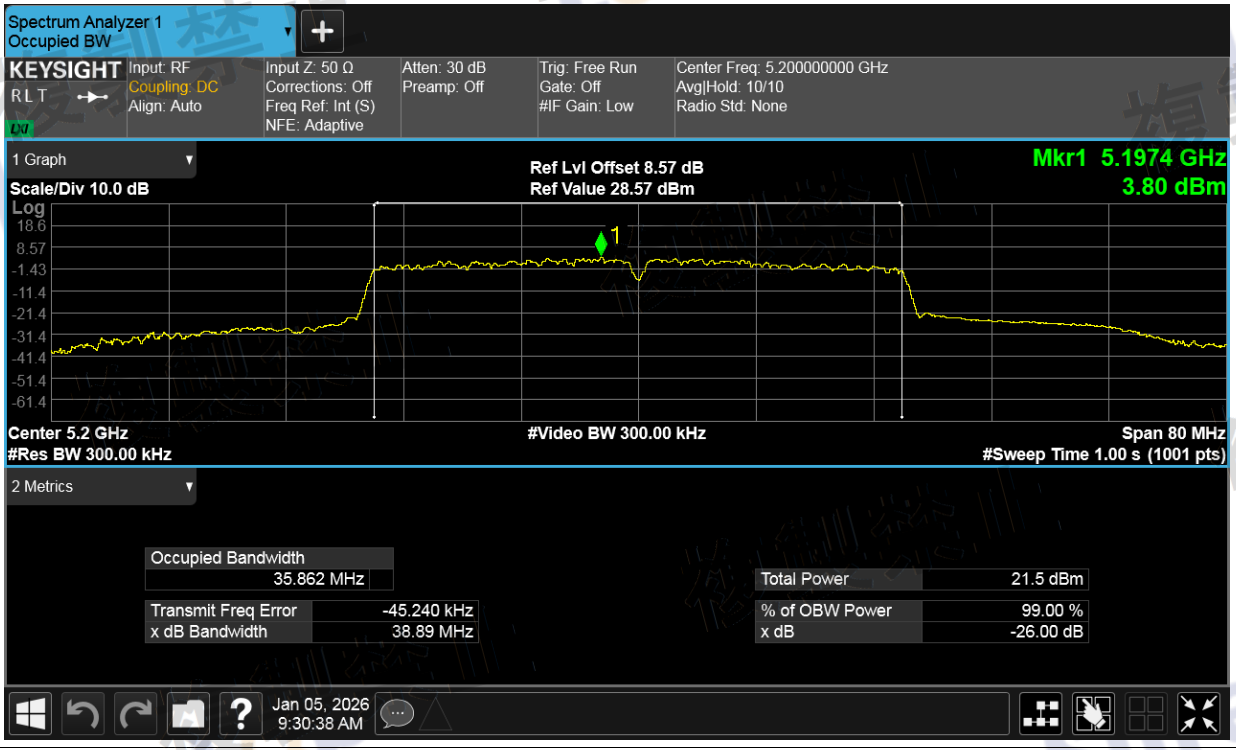


OBW NVNT ac40 5230MHz Ant1




OBW NVNT ac40 5270MHz Ant1

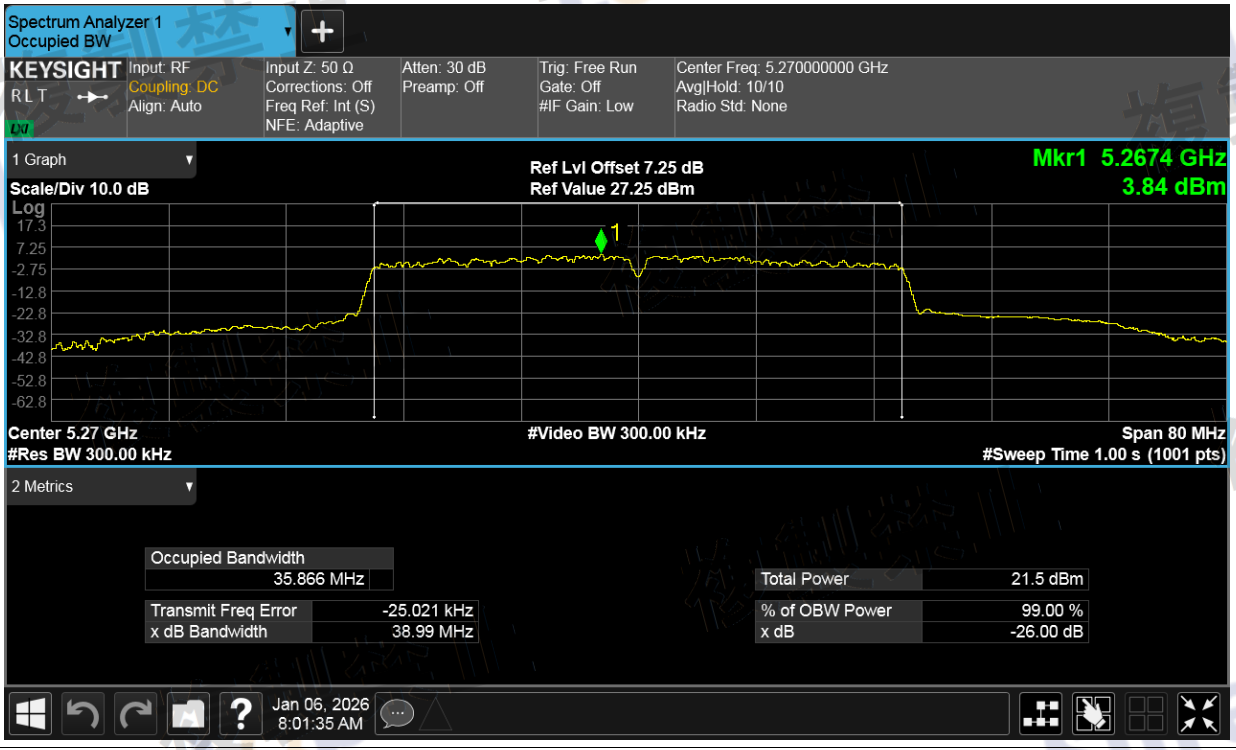


OBW NVNT ac40 5310MHz Ant1

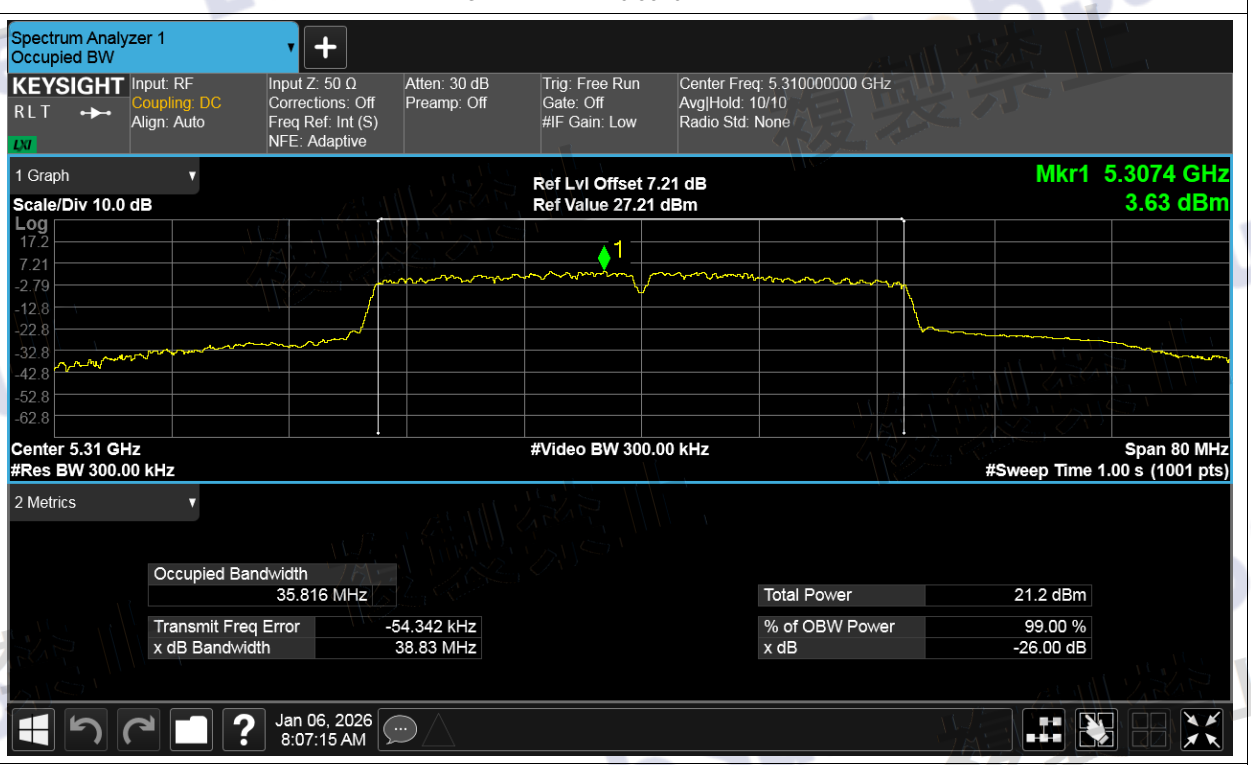

OBW NVNT ac40 5510MHz Ant1

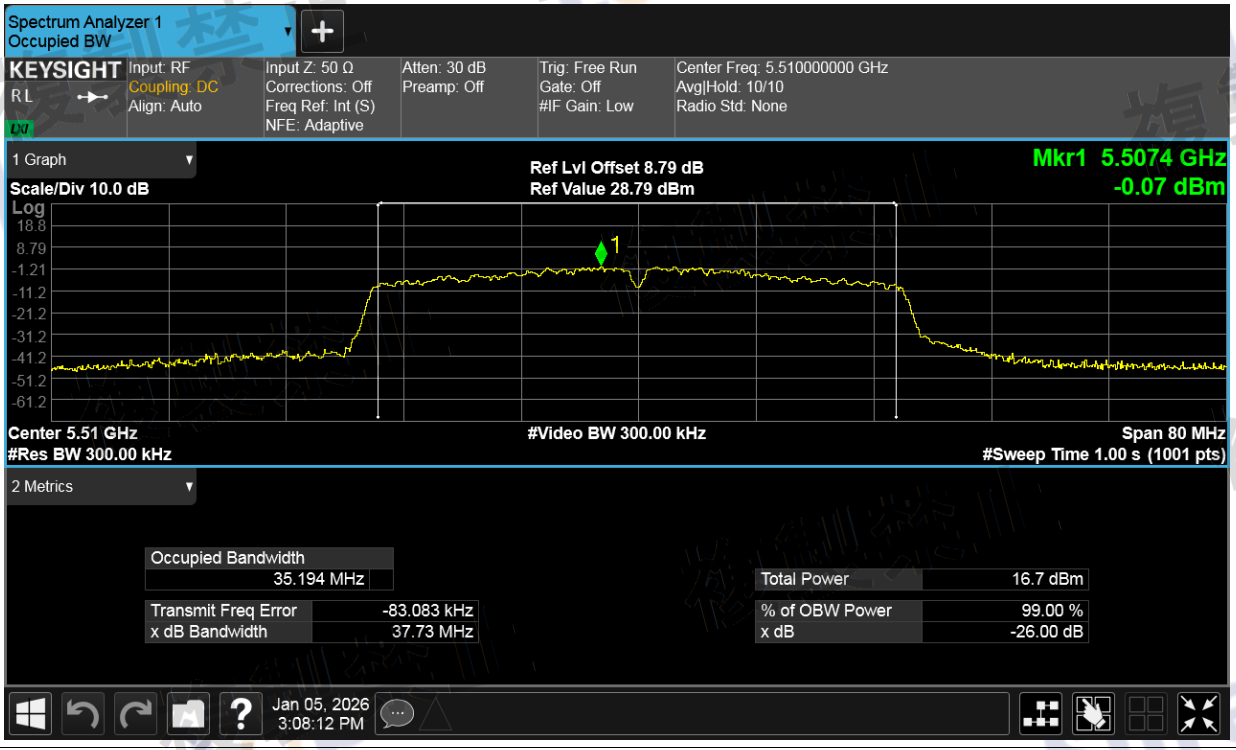


OBW NVNT ac40 5590MHz Ant1

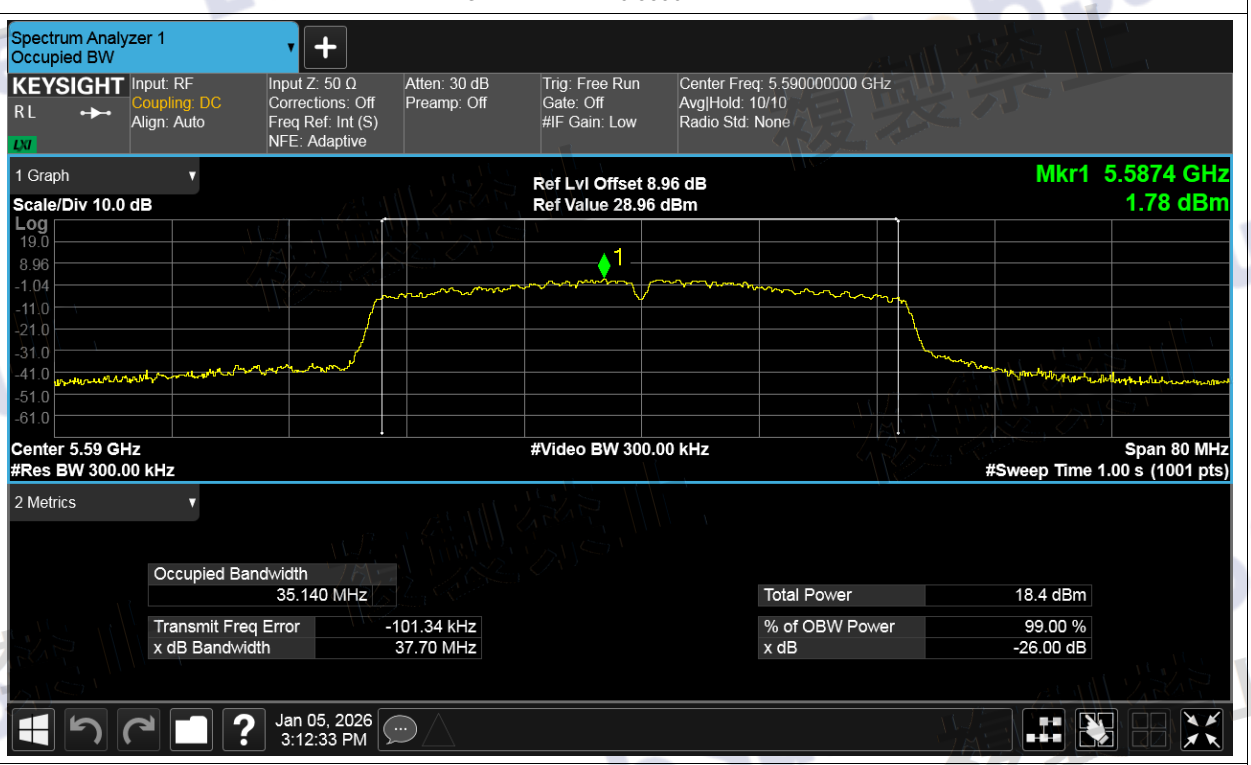


OBW NVNT ac40 5670MHz Ant1



OBW NVNT ax20 5180MHz Ant1

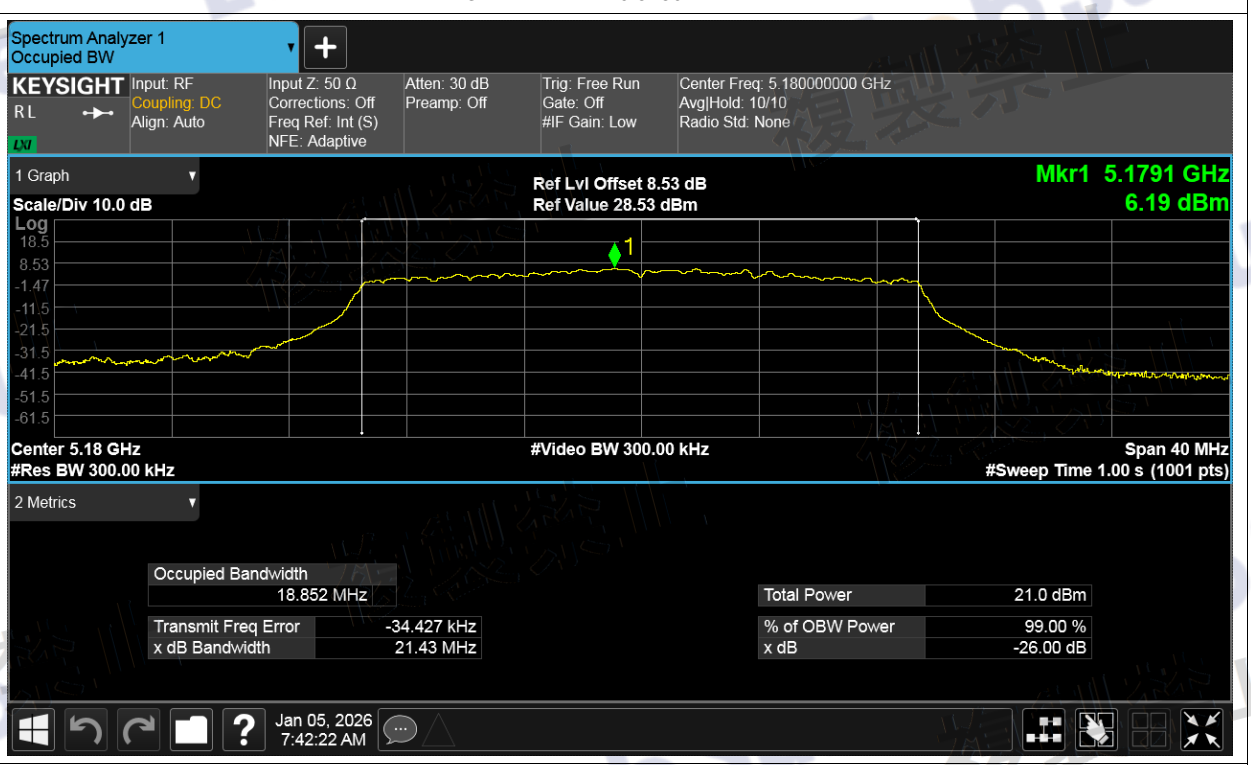


OBW NVNT ax20 5200MHz Ant1

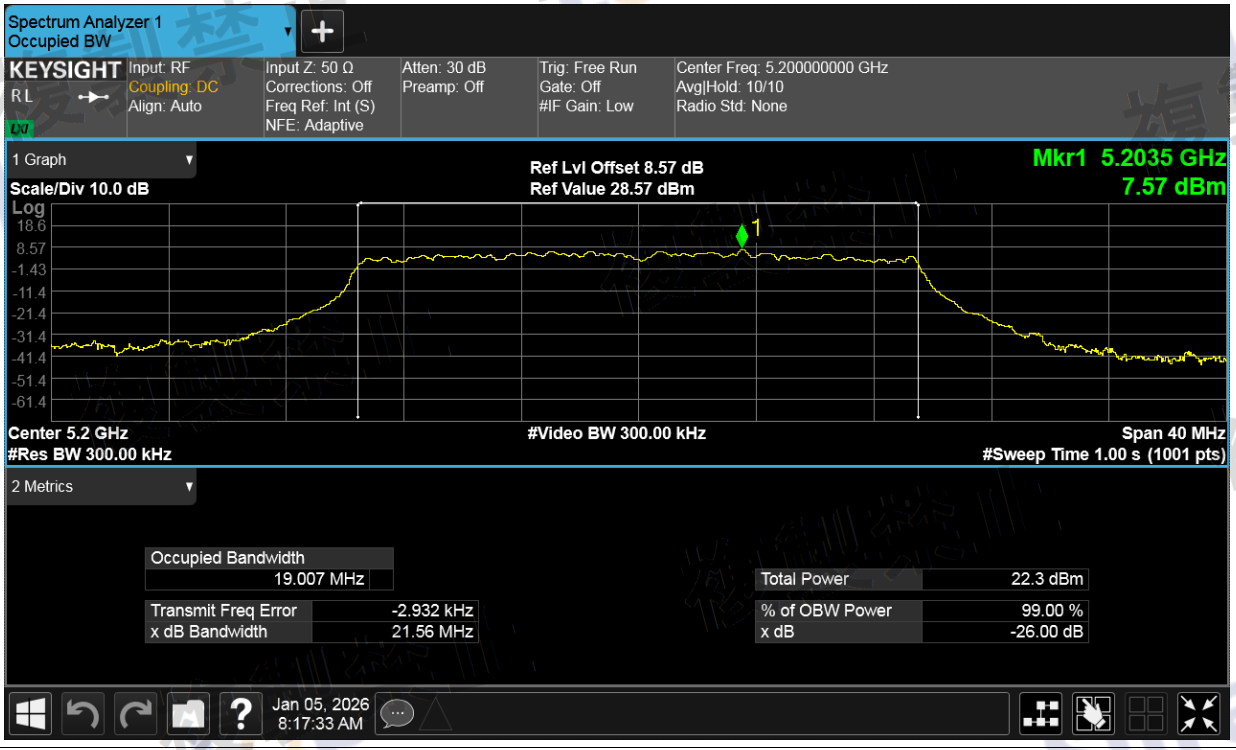

OBW NVNT ax20 5240MHz Ant1




OBW NVNT ax20 5260MHz Ant1

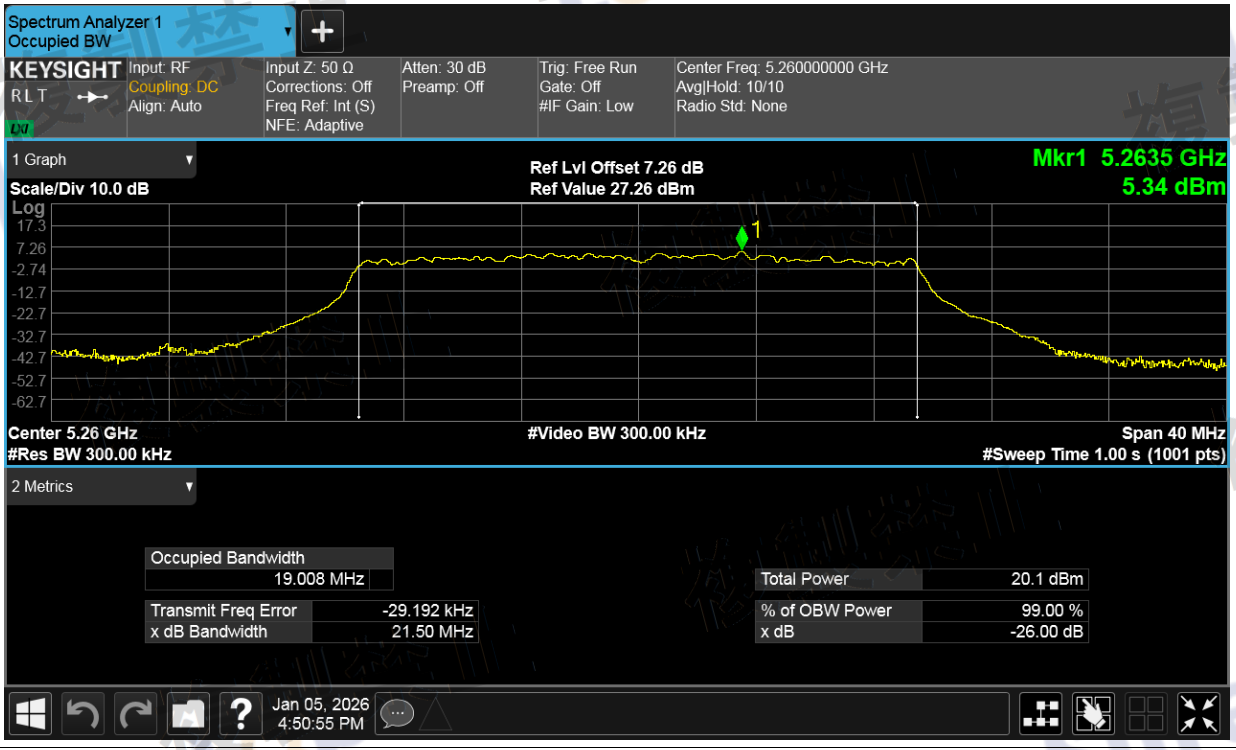

OBW NVNT ax20 5300MHz Ant1




OBW NVNT ax20 5320MHz Ant1

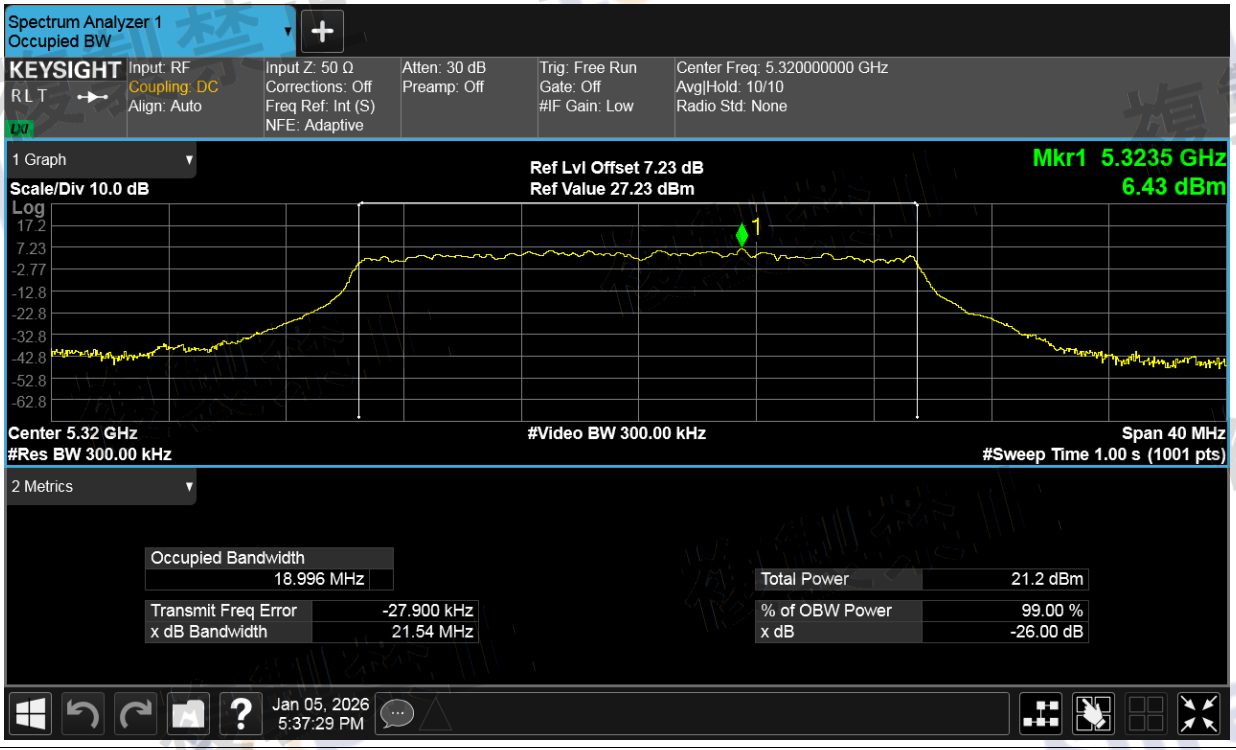

OBW NVNT ax20 5500MHz Ant1




OBW NVNT ax20 5580MHz Ant1

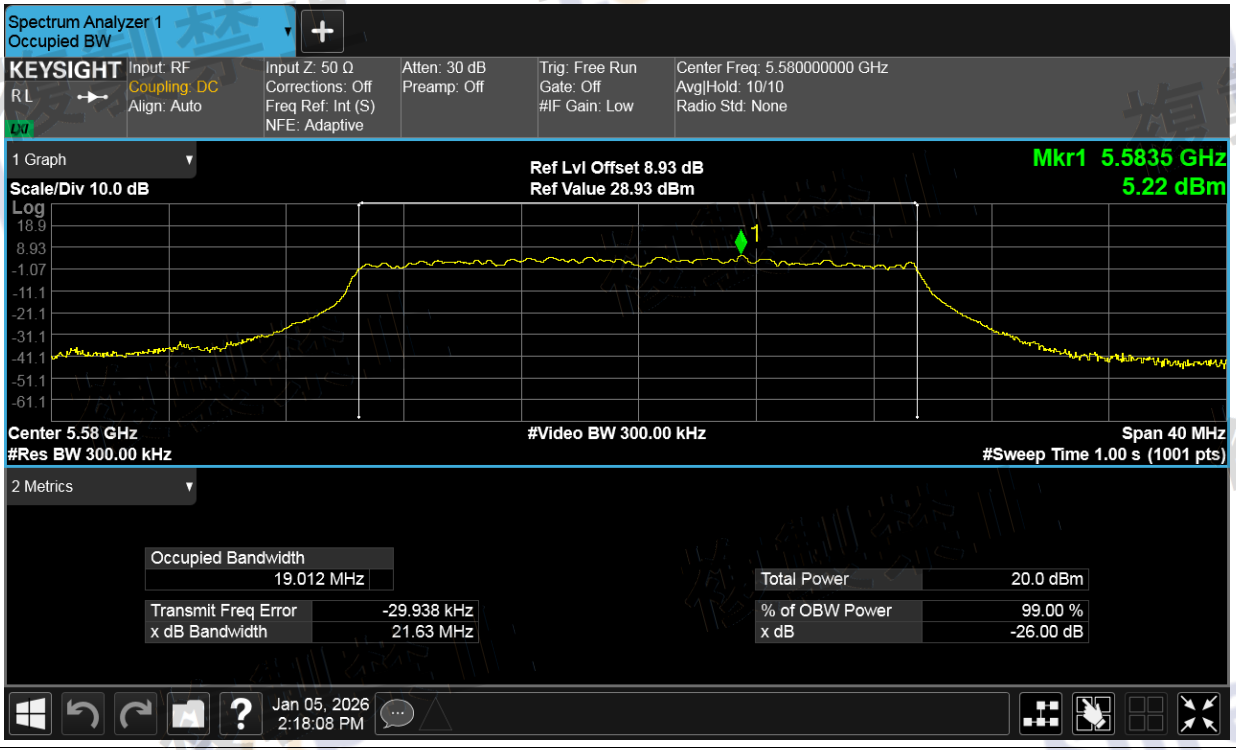


OBW NVNT ax20 5700MHz Ant1




OBW NVNT ax40 5190MHz Ant1

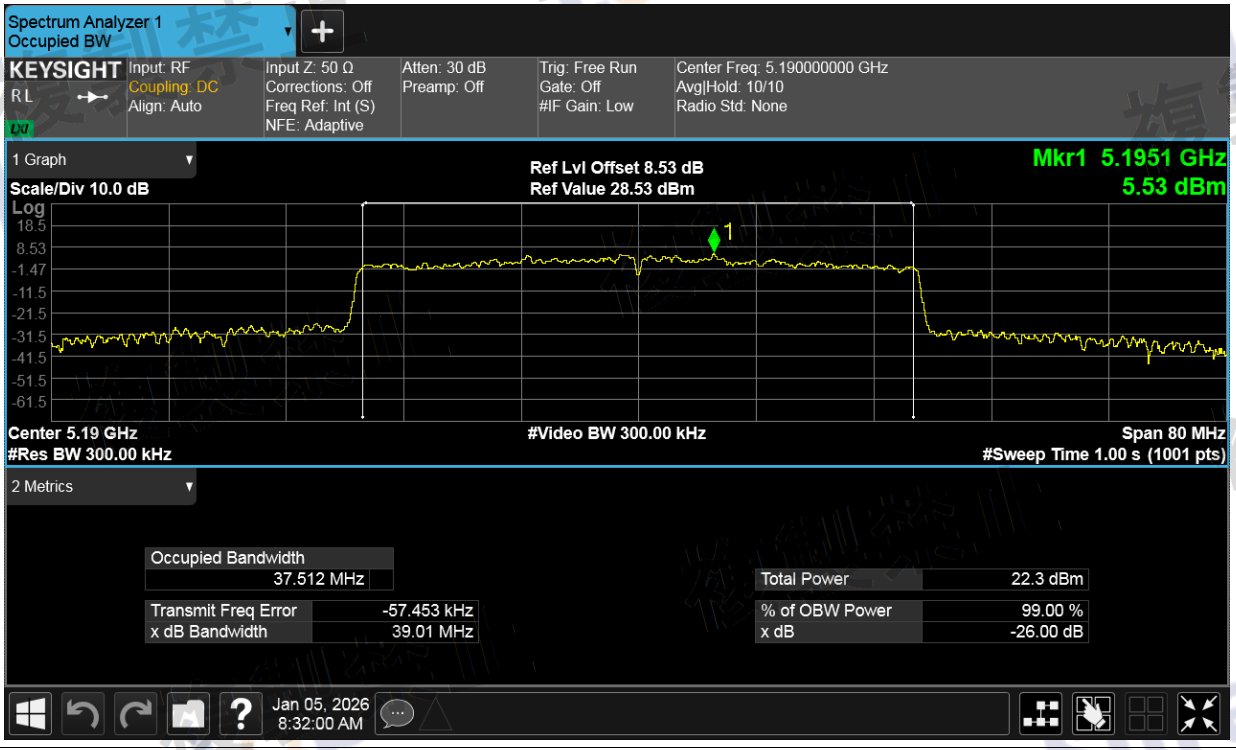


OBW NVNT ax40 5200MHz Ant1

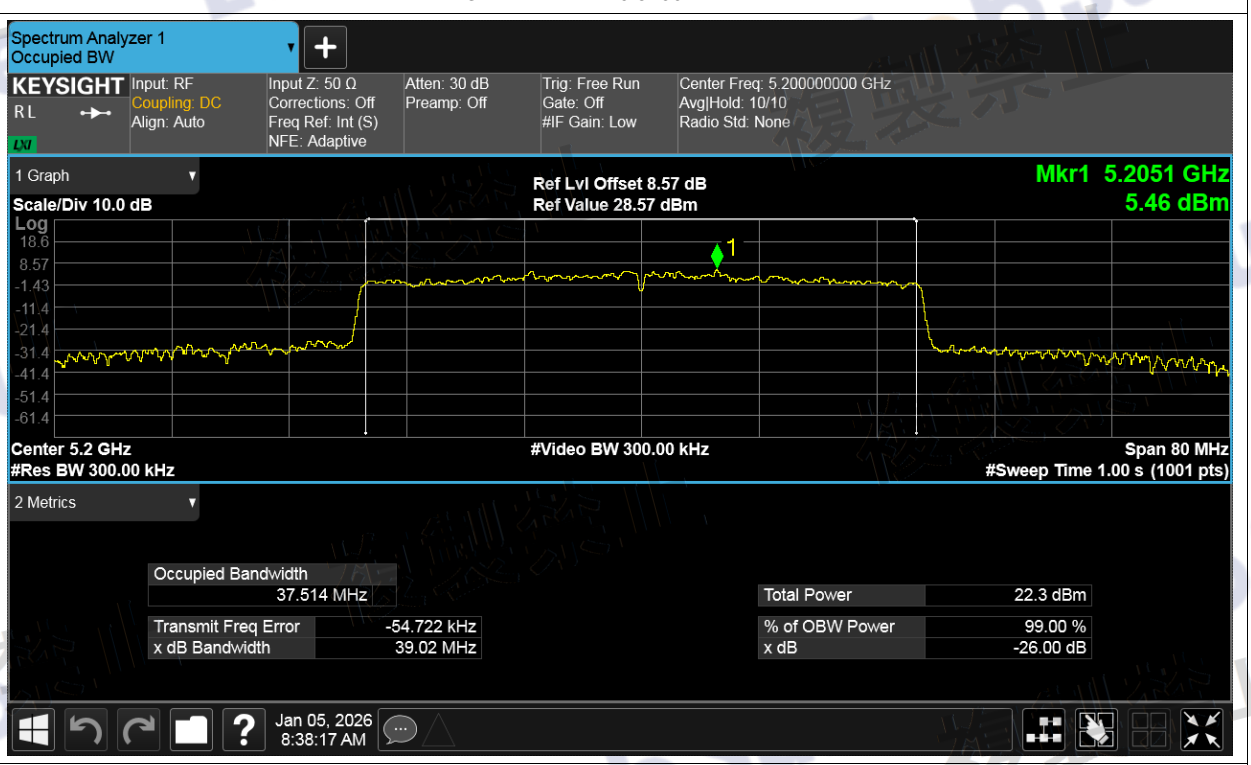


OBW NVNT ax40 5230MHz Ant1

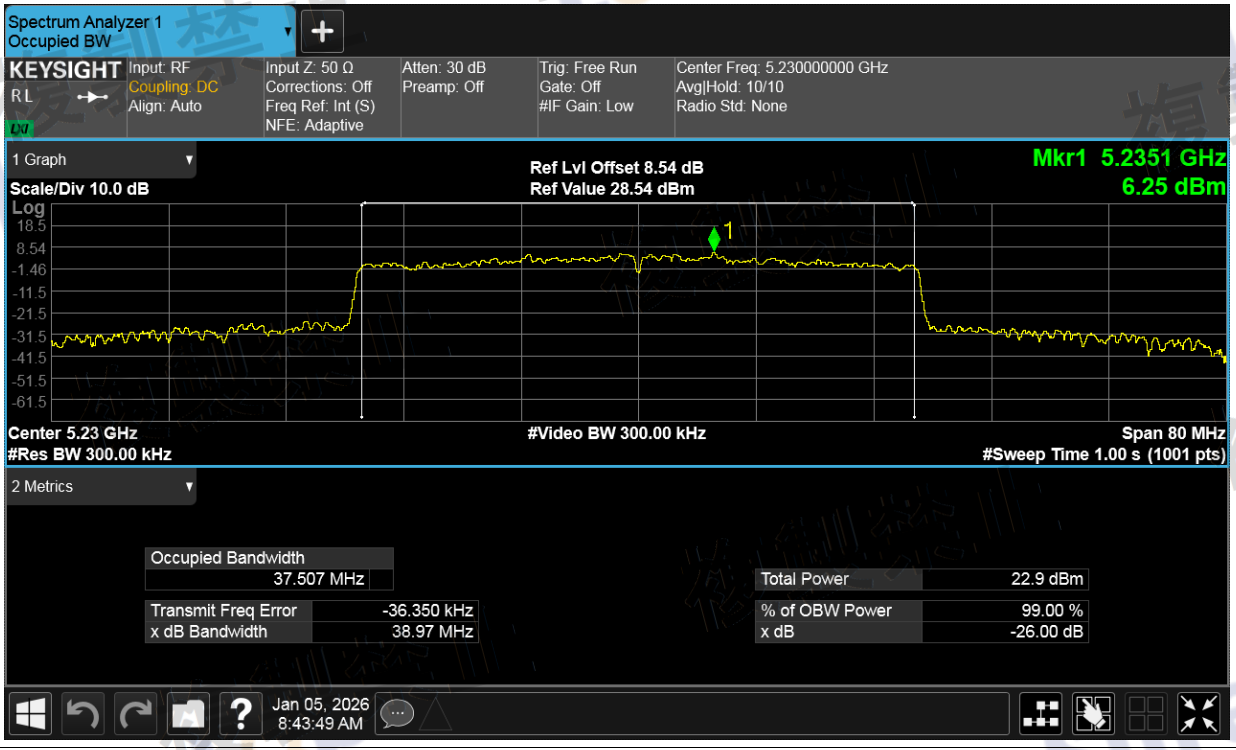

OBW NVNT ax40 5270MHz Ant1

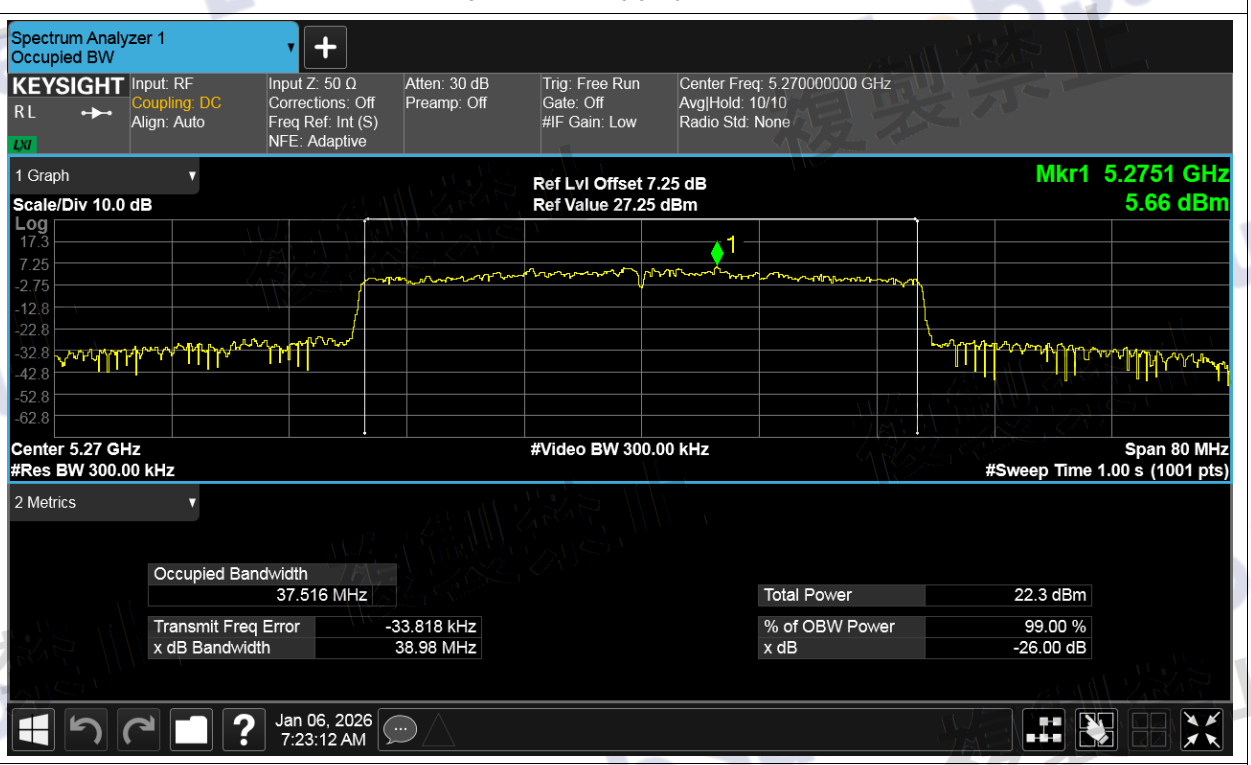


OBW NVNT ax40 5310MHz Ant1

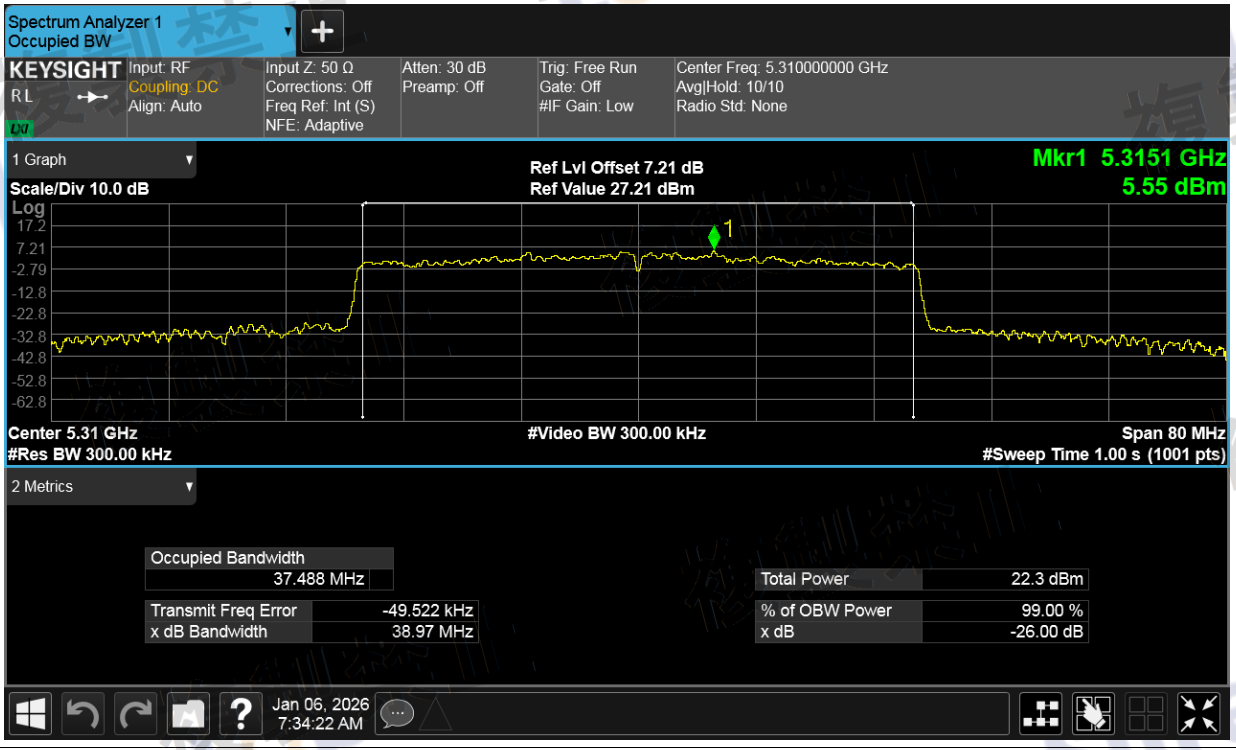

OBW NVNT ax40 5510MHz Ant1



OBW NVNT ax40 5590MHz Ant1

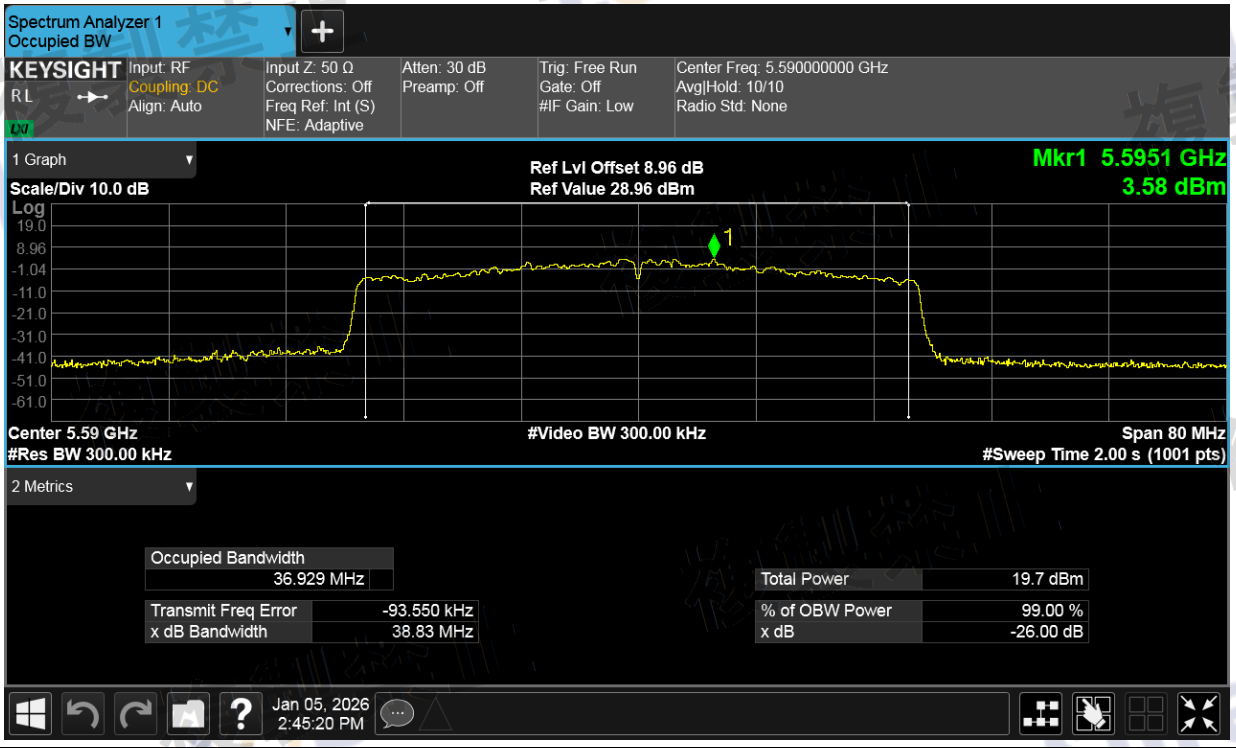

OBW NVNT ax40 5670MHz Ant1




Spreading Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	90% OBW (MHz)	Limit (MHz)	Verdict
NVNT	a	5180	Ant1	14.426	0.5	Pass
NVNT	a	5200	Ant1	14.426	0.5	Pass
NVNT	a	5240	Ant1	14.407	0.5	Pass
NVNT	a	5260	Ant1	14.407	0.5	Pass
NVNT	a	5300	Ant1	14.404	0.5	Pass
NVNT	a	5320	Ant1	14.395	0.5	Pass
NVNT	a	5500	Ant1	14.423	0.5	Pass
NVNT	a	5580	Ant1	14.424	0.5	Pass
NVNT	a	5700	Ant1	14.422	0.5	Pass
NVNT	n20	5180	Ant1	15.251	0.5	Pass
NVNT	n20	5200	Ant1	15.267	0.5	Pass
NVNT	n20	5240	Ant1	15.238	0.5	Pass
NVNT	n20	5260	Ant1	15.254	0.5	Pass
NVNT	n20	5300	Ant1	15.235	0.5	Pass
NVNT	n20	5320	Ant1	15.245	0.5	Pass
NVNT	n20	5500	Ant1	15.281	0.5	Pass
NVNT	n20	5580	Ant1	15.271	0.5	Pass
NVNT	n20	5700	Ant1	15.27	0.5	Pass
NVNT	n40	5190	Ant1	30.603	0.5	Pass
NVNT	n40	5200	Ant1	30.761	0.5	Pass
NVNT	n40	5230	Ant1	30.586	0.5	Pass
NVNT	n40	5270	Ant1	27.45	0.5	Pass
NVNT	n40	5310	Ant1	27.35	0.5	Pass
NVNT	n40	5510	Ant1	27.567	0.5	Pass
NVNT	n40	5590	Ant1	27.29	0.5	Pass
NVNT	n40	5670	Ant1	27.361	0.5	Pass
NVNT	ac20	5180	Ant1	15.308	0.5	Pass
NVNT	ac20	5200	Ant1	15.327	0.5	Pass
NVNT	ac20	5240	Ant1	15.277	0.5	Pass
NVNT	ac20	5260	Ant1	15.307	0.5	Pass
NVNT	ac20	5300	Ant1	15.301	0.5	Pass
NVNT	ac20	5320	Ant1	15.314	0.5	Pass
NVNT	ac20	5500	Ant1	15.346	0.5	Pass
NVNT	ac20	5580	Ant1	15.347	0.5	Pass
NVNT	ac20	5700	Ant1	15.33	0.5	Pass
NVNT	ac40	5190	Ant1	30.654	0.5	Pass
NVNT	ac40	5200	Ant1	30.733	0.5	Pass
NVNT	ac40	5230	Ant1	30.58	0.5	Pass
NVNT	ac40	5270	Ant1	30.708	0.5	Pass
NVNT	ac40	5310	Ant1	30.621	0.5	Pass
NVNT	ac40	5510	Ant1	27.481	0.5	Pass

NVNT	ac40	5590	Ant1	27.103	0.5	Pass
NVNT	ac40	5670	Ant1	26.99	0.5	Pass
NVNT	ax20	5180	Ant1	16.426	0.5	Pass
NVNT	ax20	5200	Ant1	16.42	0.5	Pass
NVNT	ax20	5240	Ant1	16.436	0.5	Pass
NVNT	ax20	5260	Ant1	16.457	0.5	Pass
NVNT	ax20	5300	Ant1	16.427	0.5	Pass
NVNT	ax20	5320	Ant1	16.392	0.5	Pass
NVNT	ax20	5500	Ant1	16.504	0.5	Pass
NVNT	ax20	5580	Ant1	16.42	0.5	Pass
NVNT	ax20	5700	Ant1	16.515	0.5	Pass
NVNT	ax40	5190	Ant1	32.254	0.5	Pass
NVNT	ax40	5200	Ant1	32.257	0.5	Pass
NVNT	ax40	5230	Ant1	32.108	0.5	Pass
NVNT	ax40	5270	Ant1	32.199	0.5	Pass
NVNT	ax40	5310	Ant1	32.069	0.5	Pass
NVNT	ax40	5510	Ant1	28.101	0.5	Pass
NVNT	ax40	5590	Ant1	27.817	0.5	Pass
NVNT	ax40	5670	Ant1	27.871	0.5	Pass


Test Graphs
Spreading Bandwidth NVNT a 5180MHz Ant1

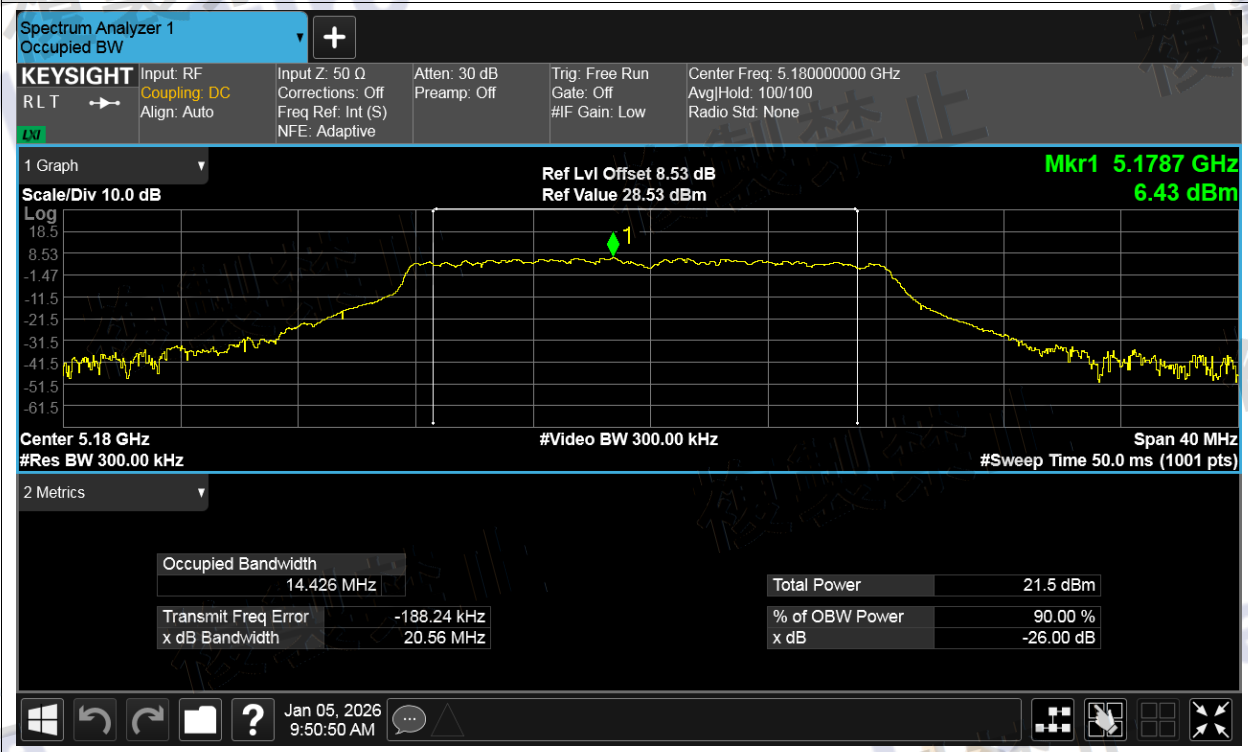


Spreading Bandwidth NVNT a 5200MHz Ant1

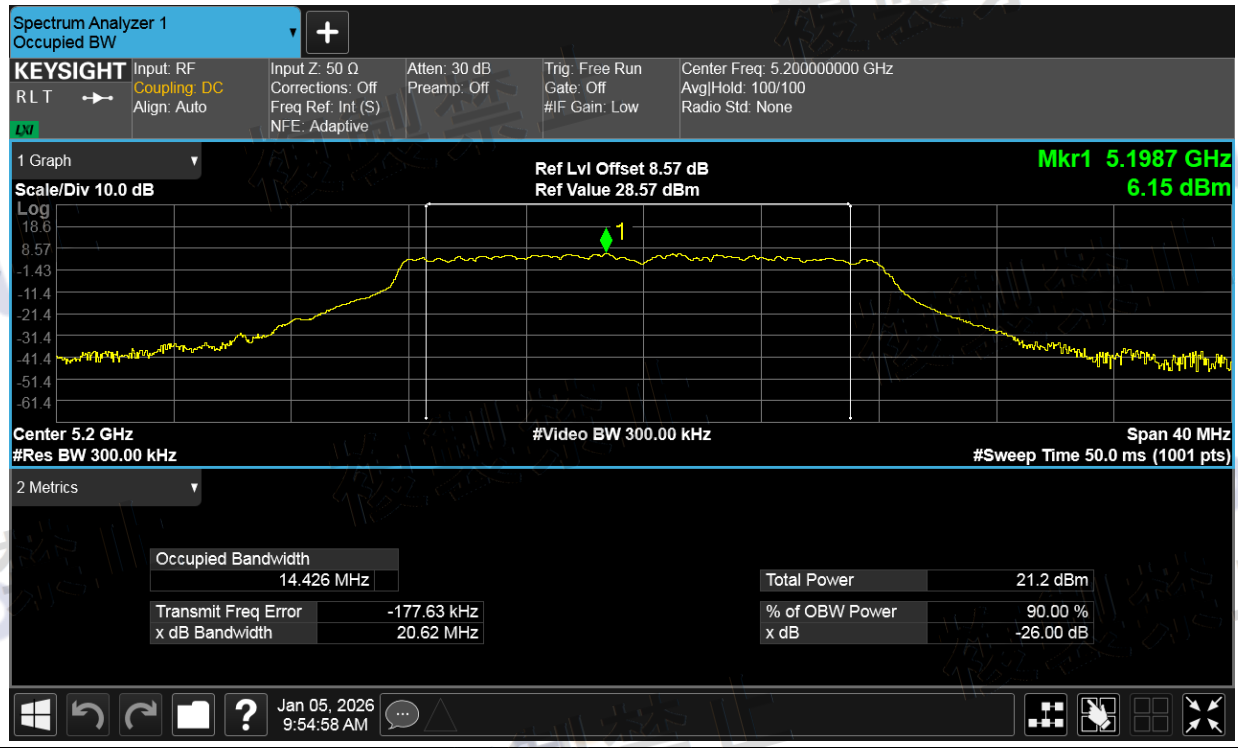


Spreading Bandwidth NVNT a 5240MHz Ant1

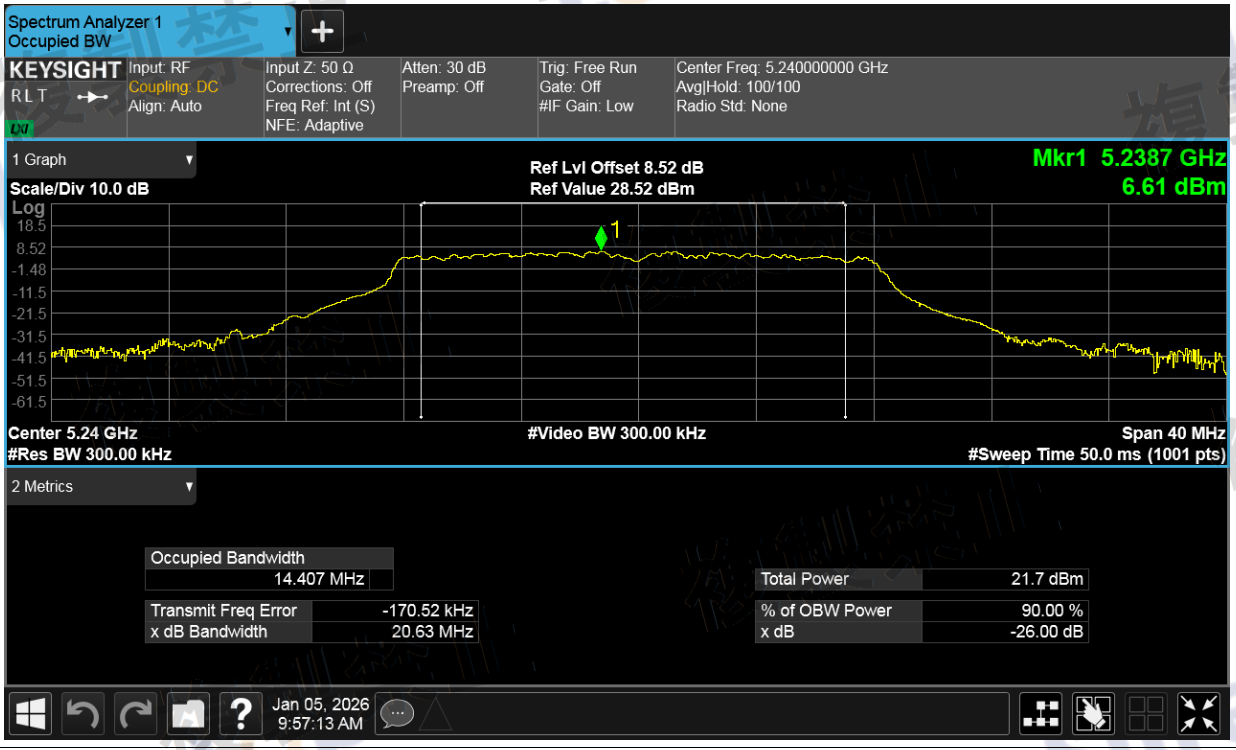


Spreading Bandwidth NVNT a 5260MHz Ant1

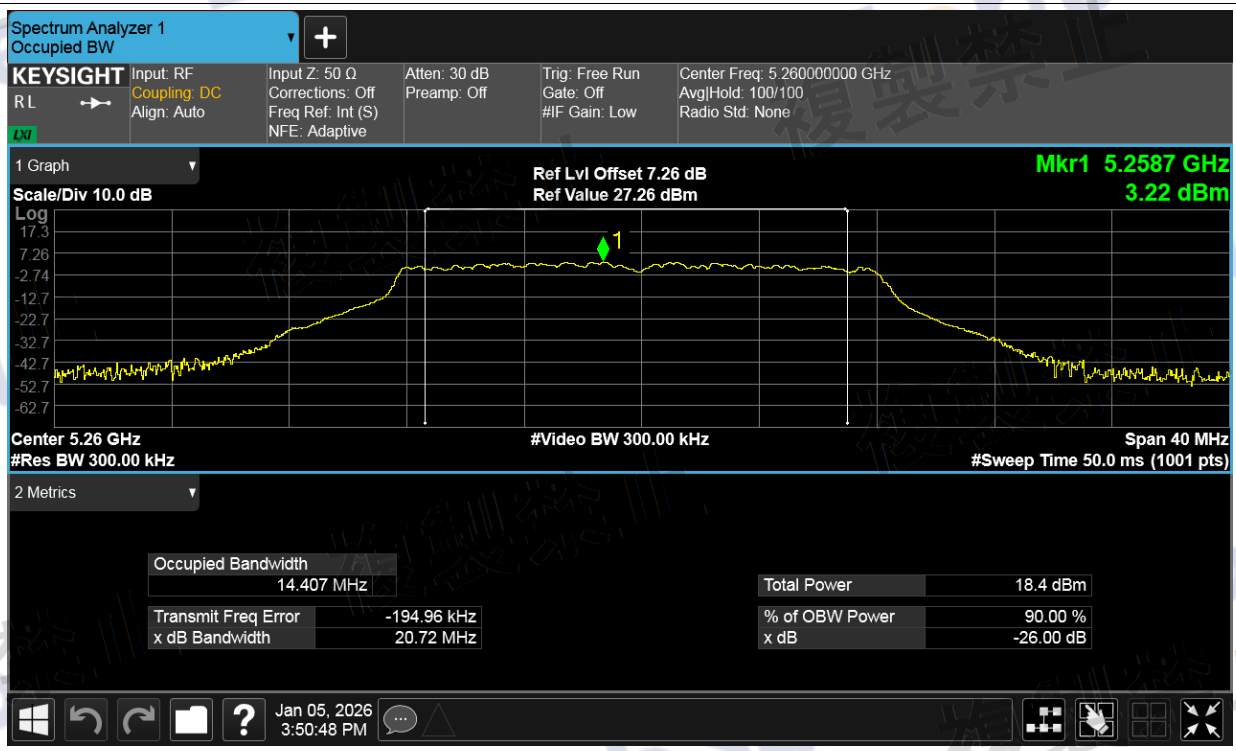


Spreading Bandwidth NVNT a 5300MHz Ant1

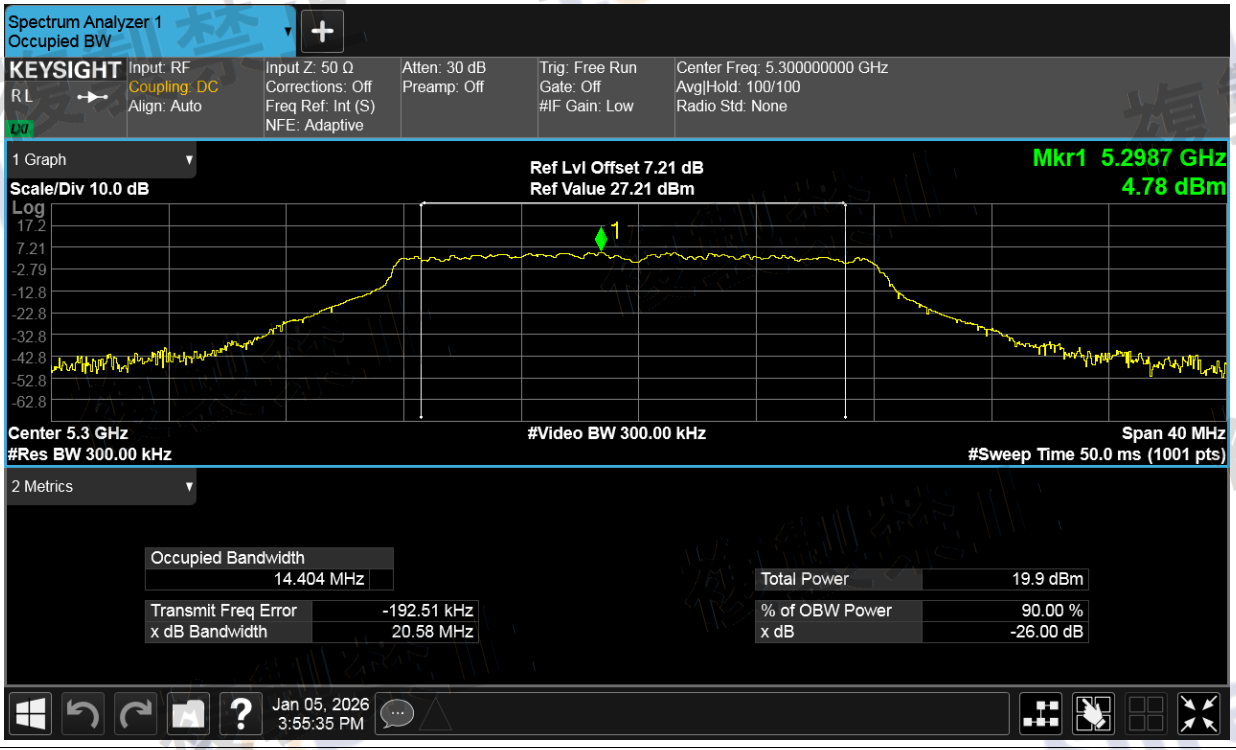


Spreading Bandwidth NVNT a 5320MHz Ant1

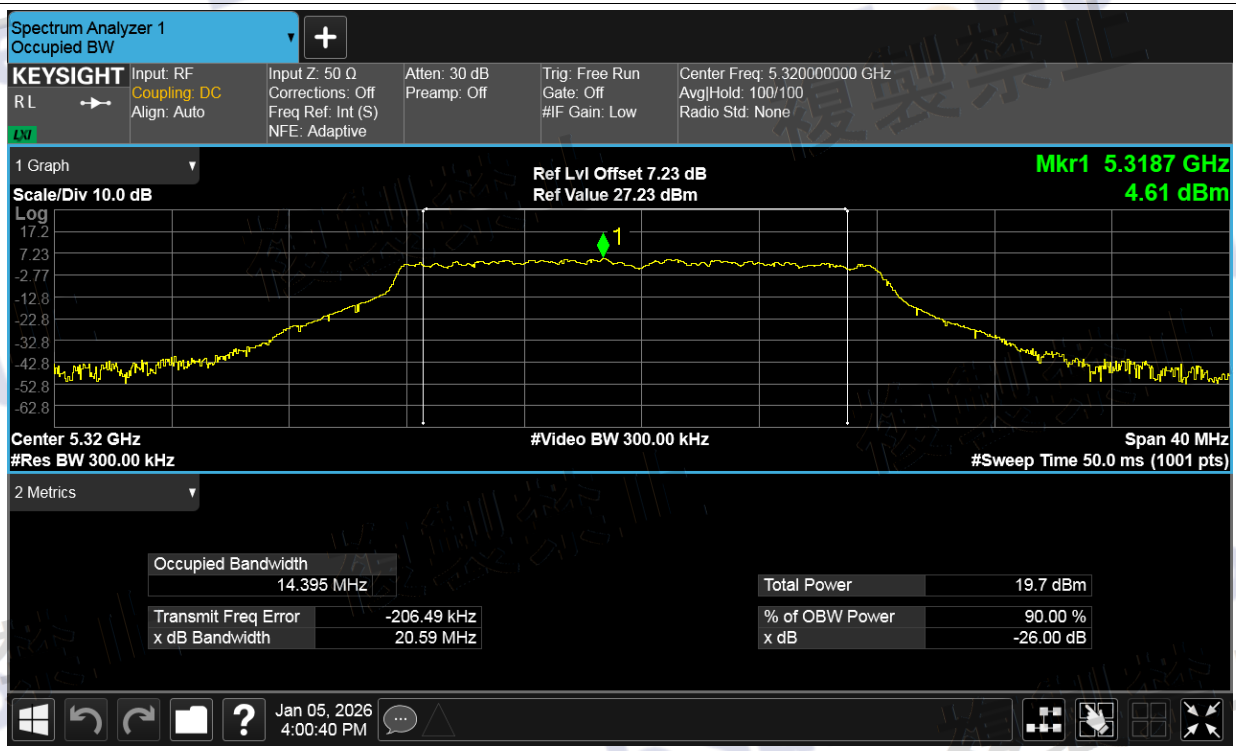


Spreading Bandwidth NVNT a 5500MHz Ant1

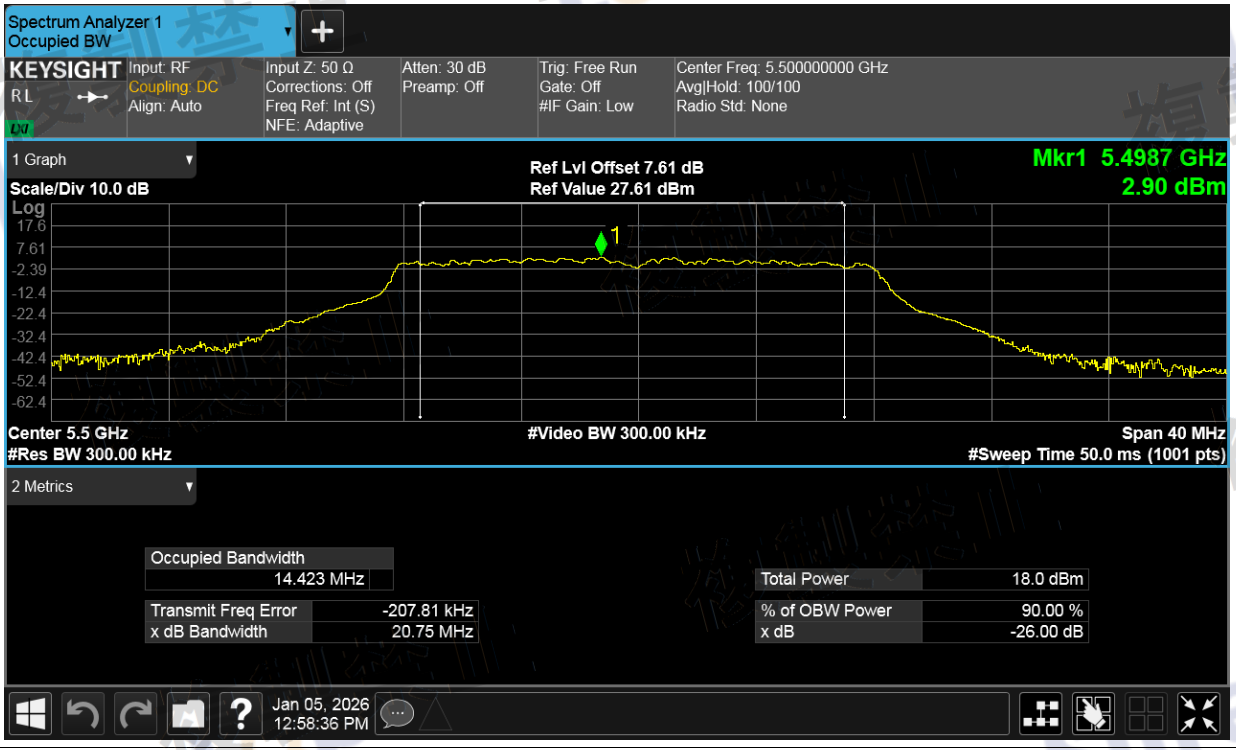


Spreading Bandwidth NVNT a 5580MHz Ant1

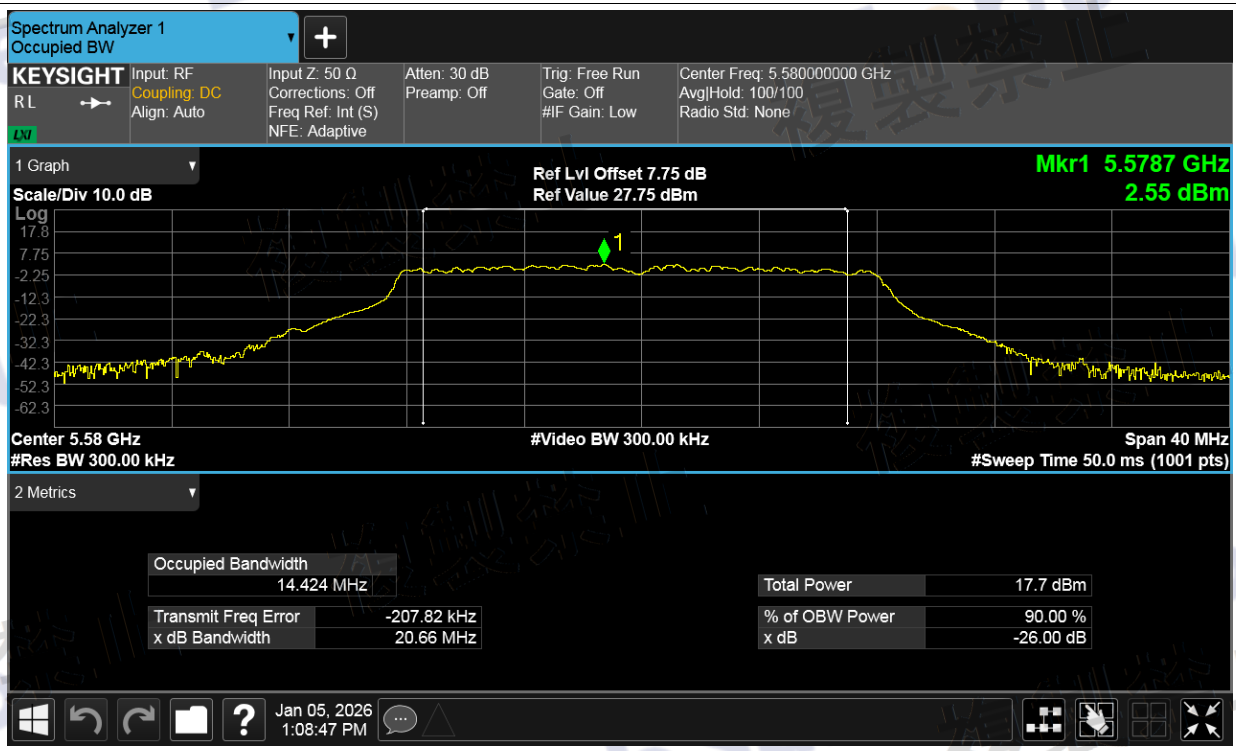


Spreading Bandwidth NVNT a 5700MHz Ant1

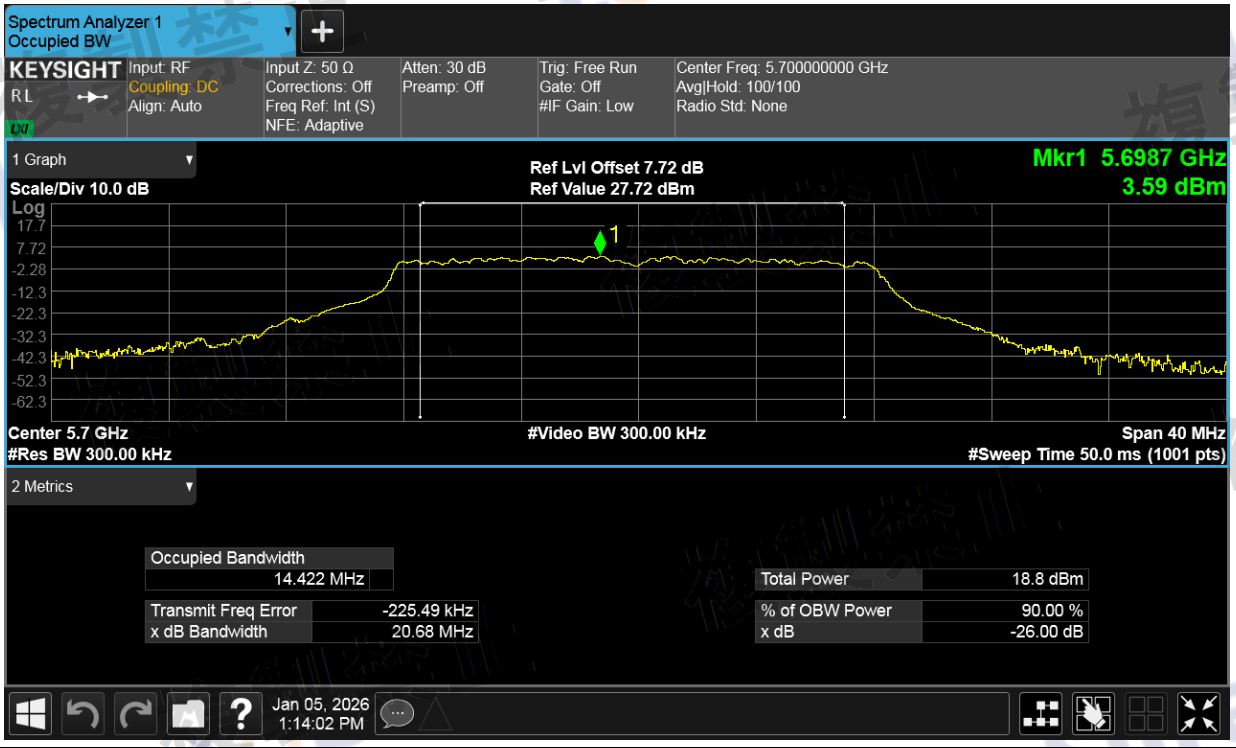


Spreading Bandwidth NVNT n20 5180MHz Ant1

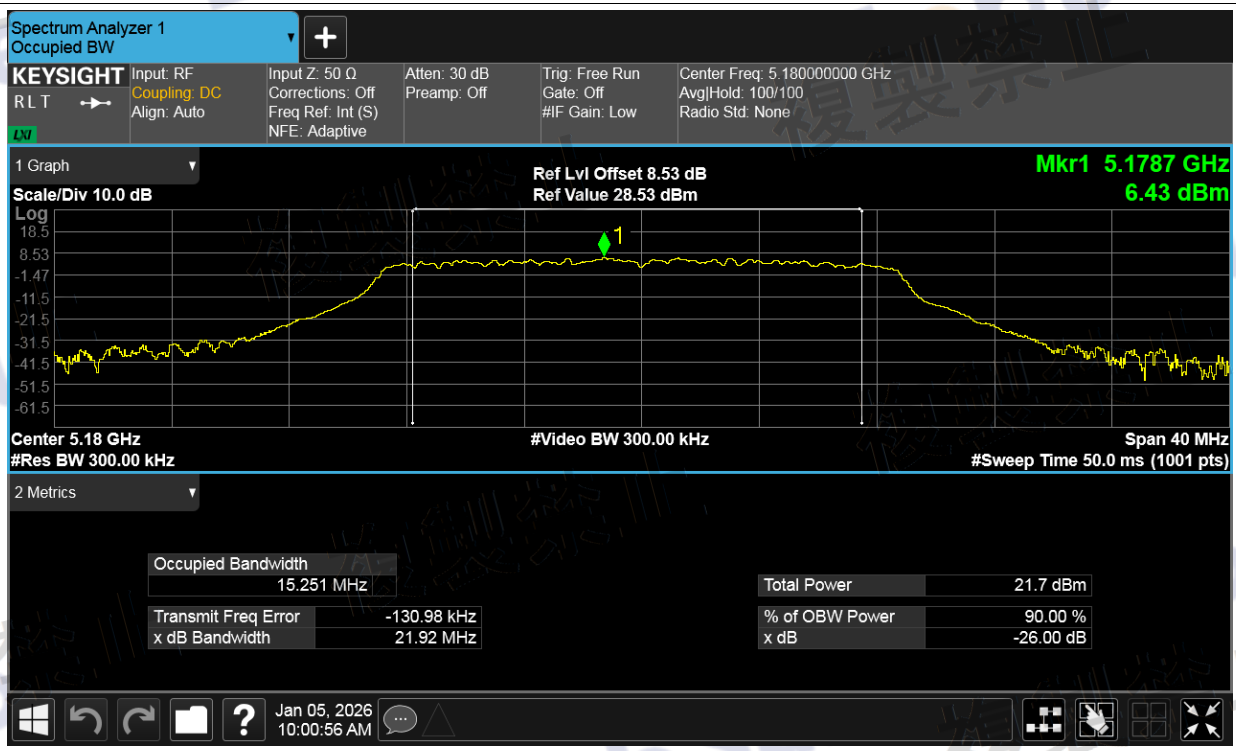


Spreading Bandwidth NVNT n20 5200MHz Ant1

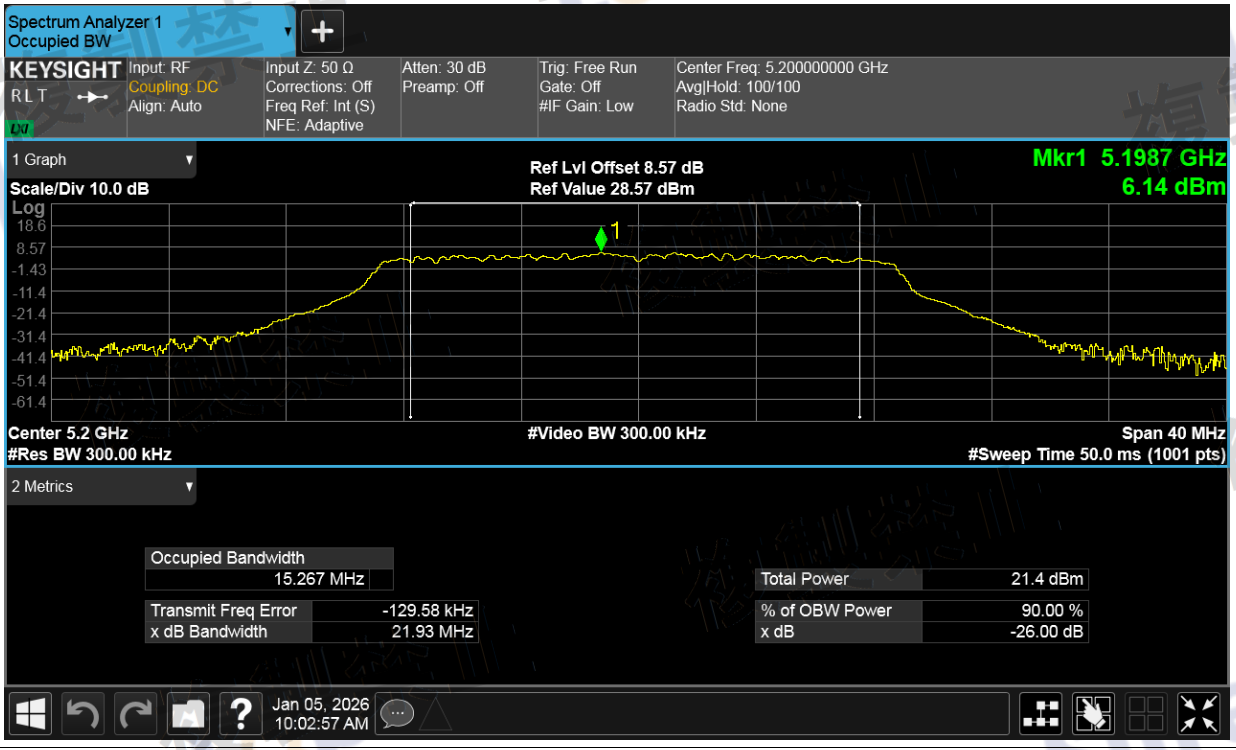


Spreading Bandwidth NVNT n20 5240MHz Ant1

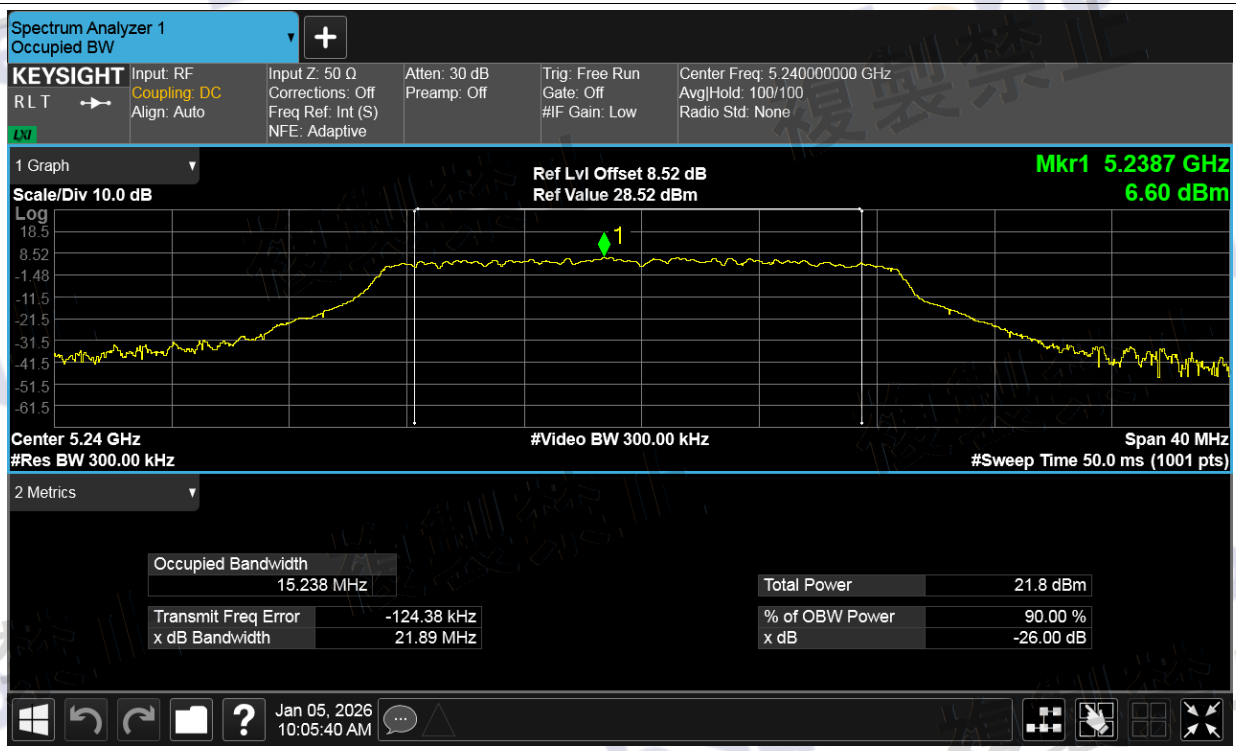

Spreading Bandwidth NVNT n20 5260MHz Ant1

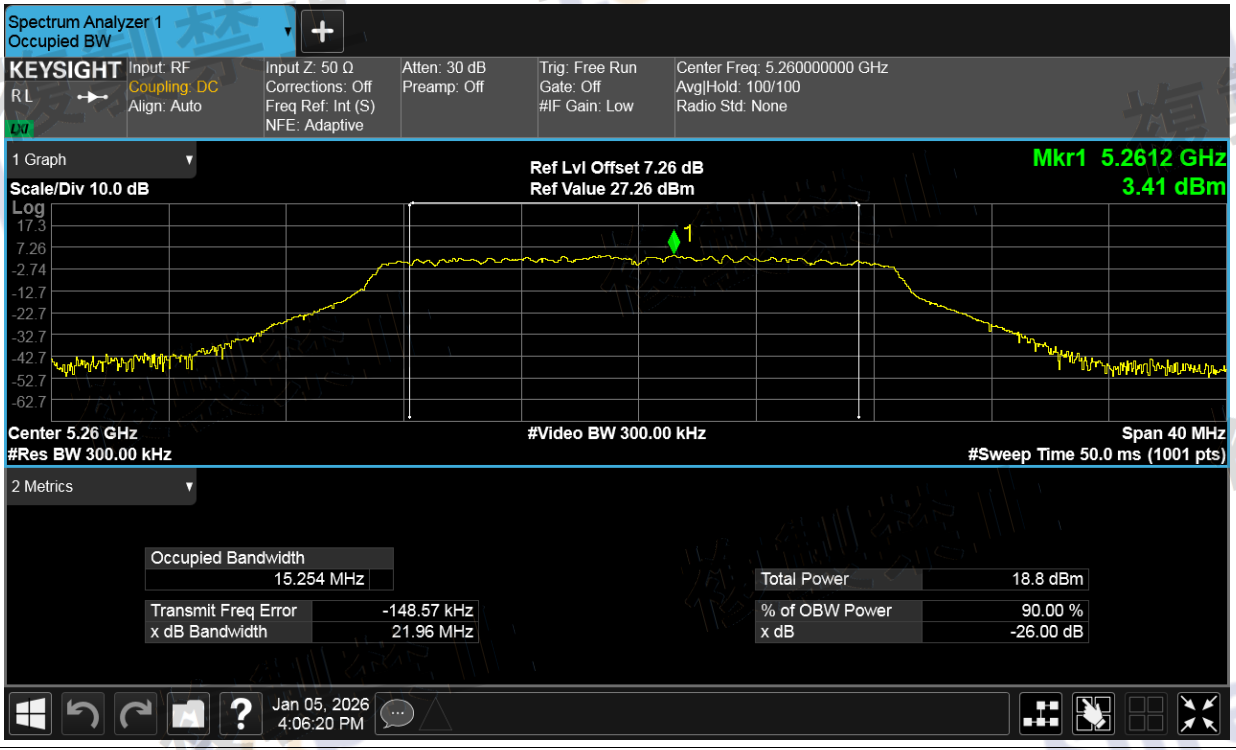


Spreading Bandwidth NVNT n20 5300MHz Ant1

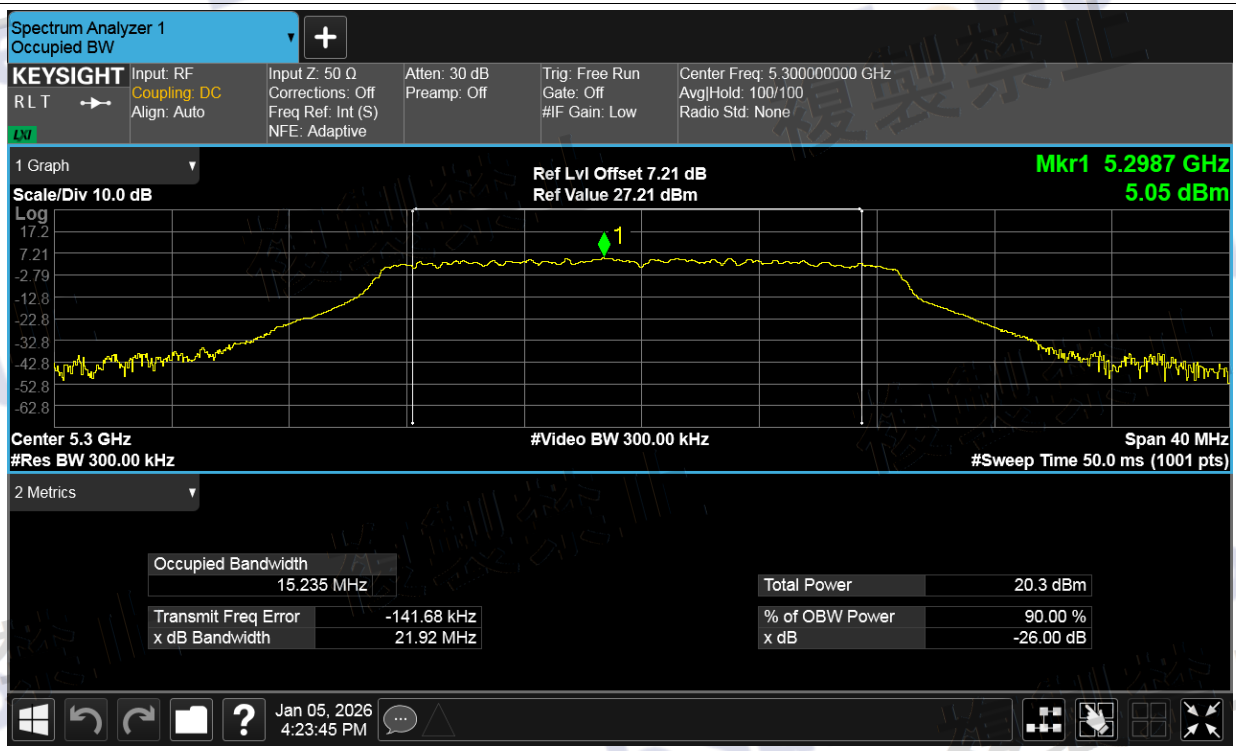


Spreading Bandwidth NVNT n20 5320MHz Ant1




Spreading Bandwidth NVNT n20 5500MHz Ant1

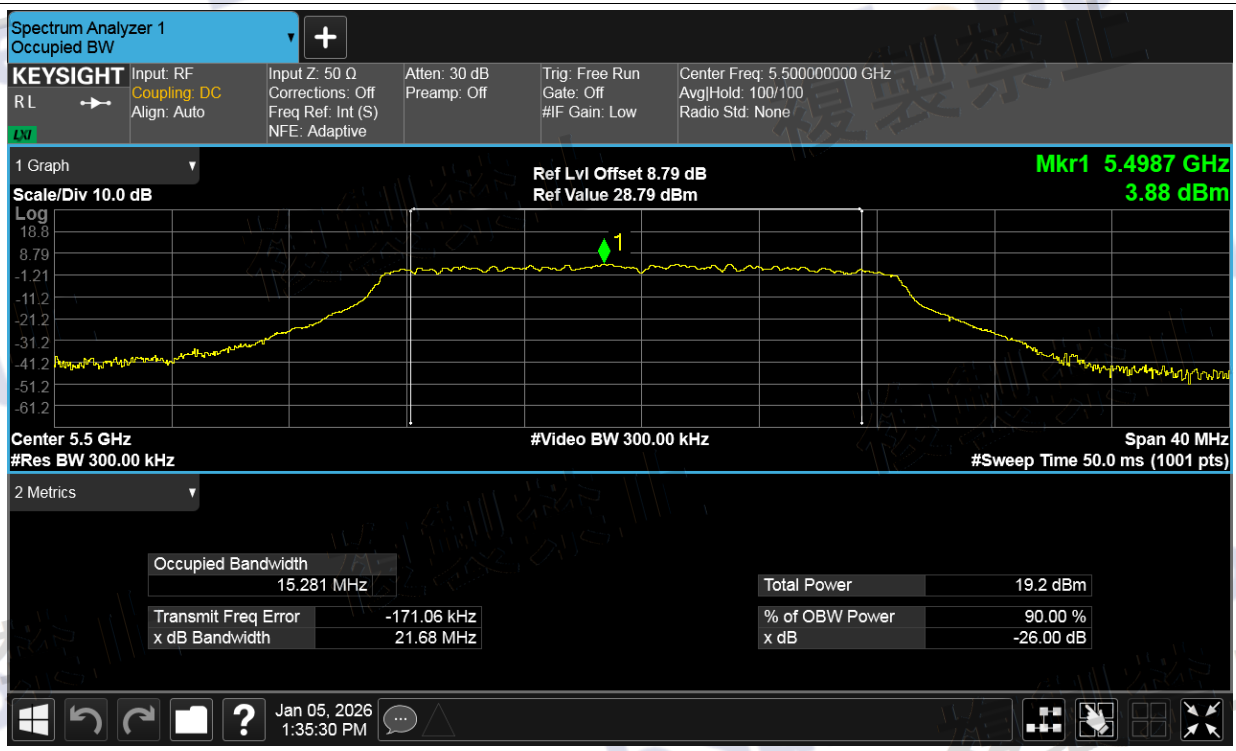


Spreading Bandwidth NVNT n20 5580MHz Ant1

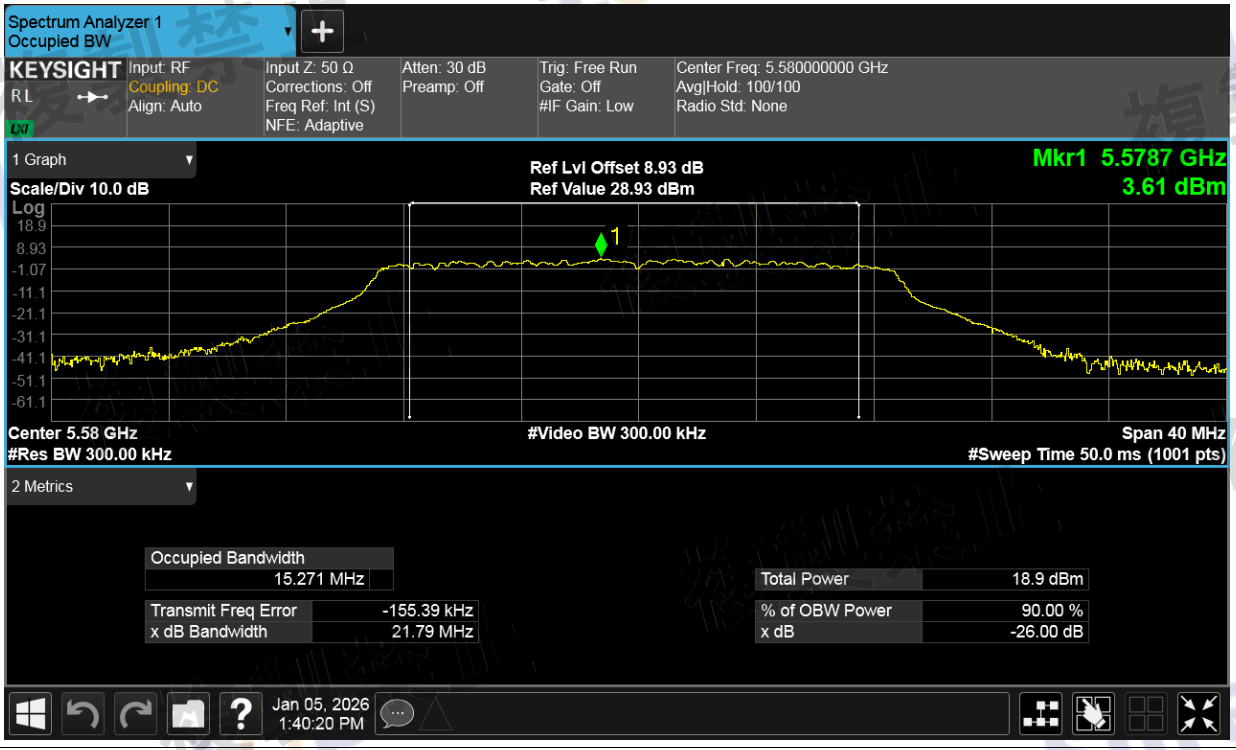


Spreading Bandwidth NVNT n20 5700MHz Ant1

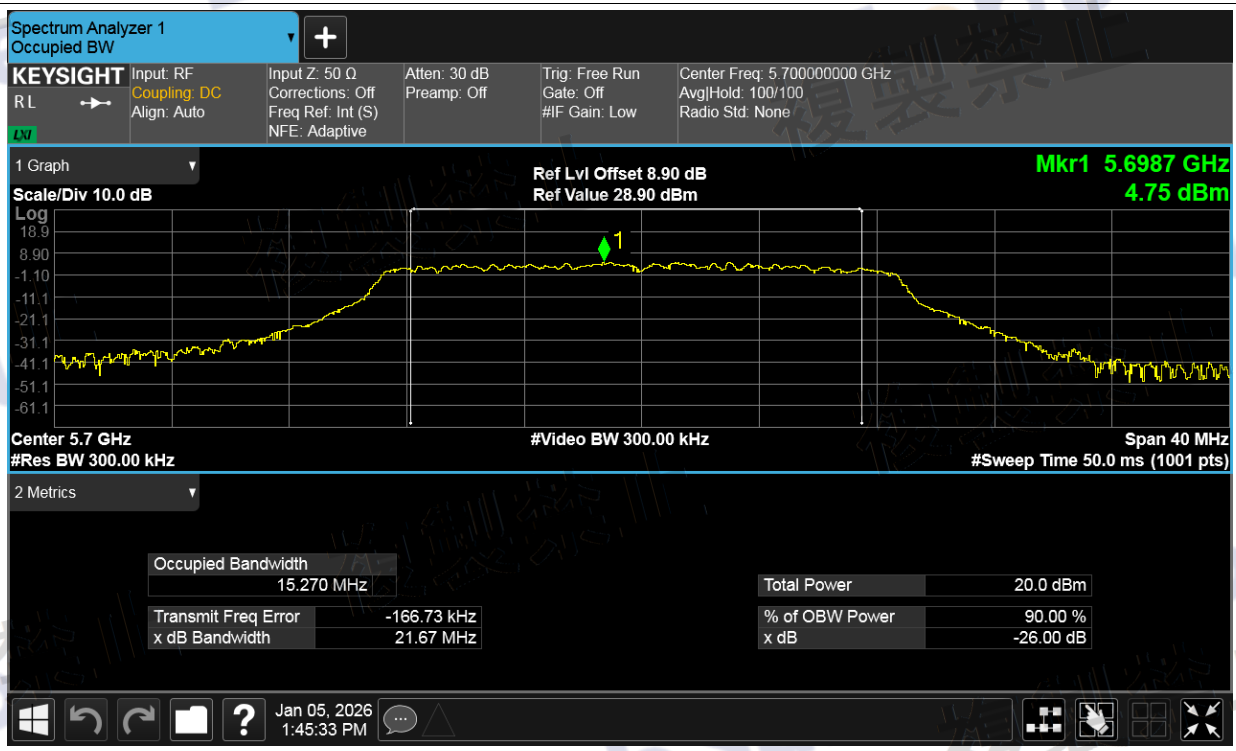


Spreading Bandwidth NVNT n40 5190MHz Ant1

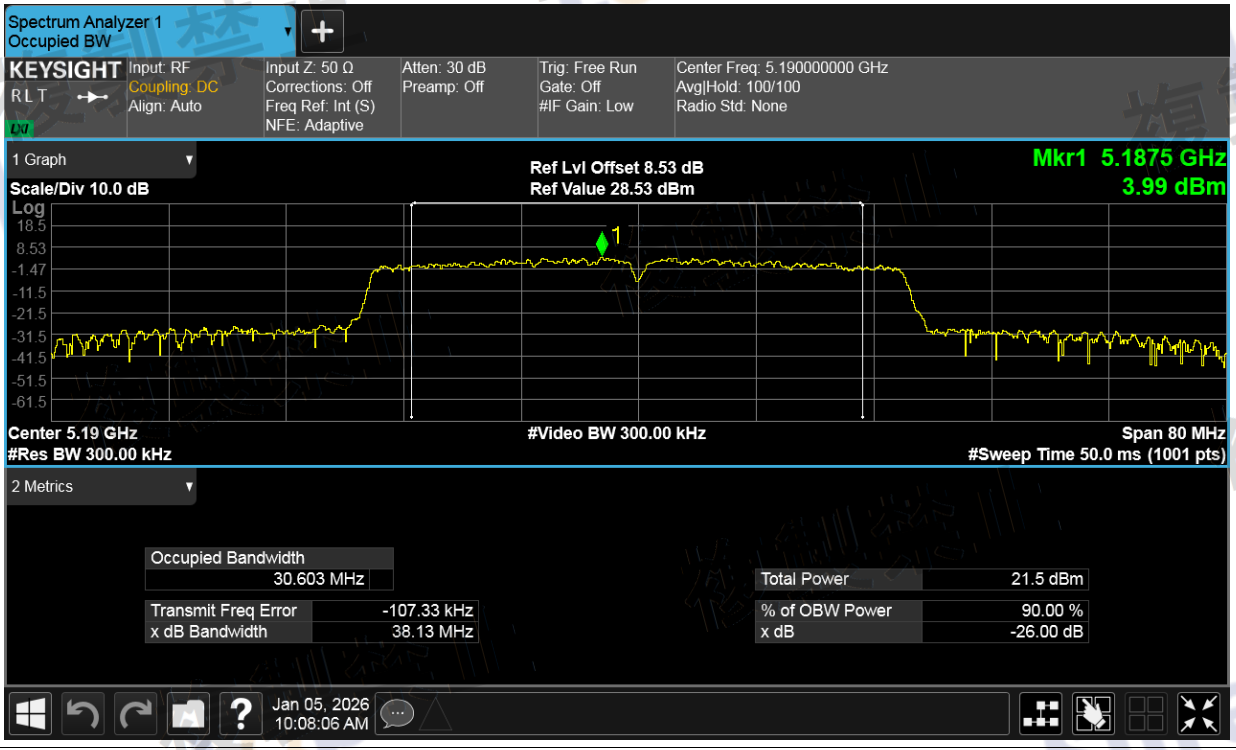

Spreading Bandwidth NVNT n40 5200MHz Ant1

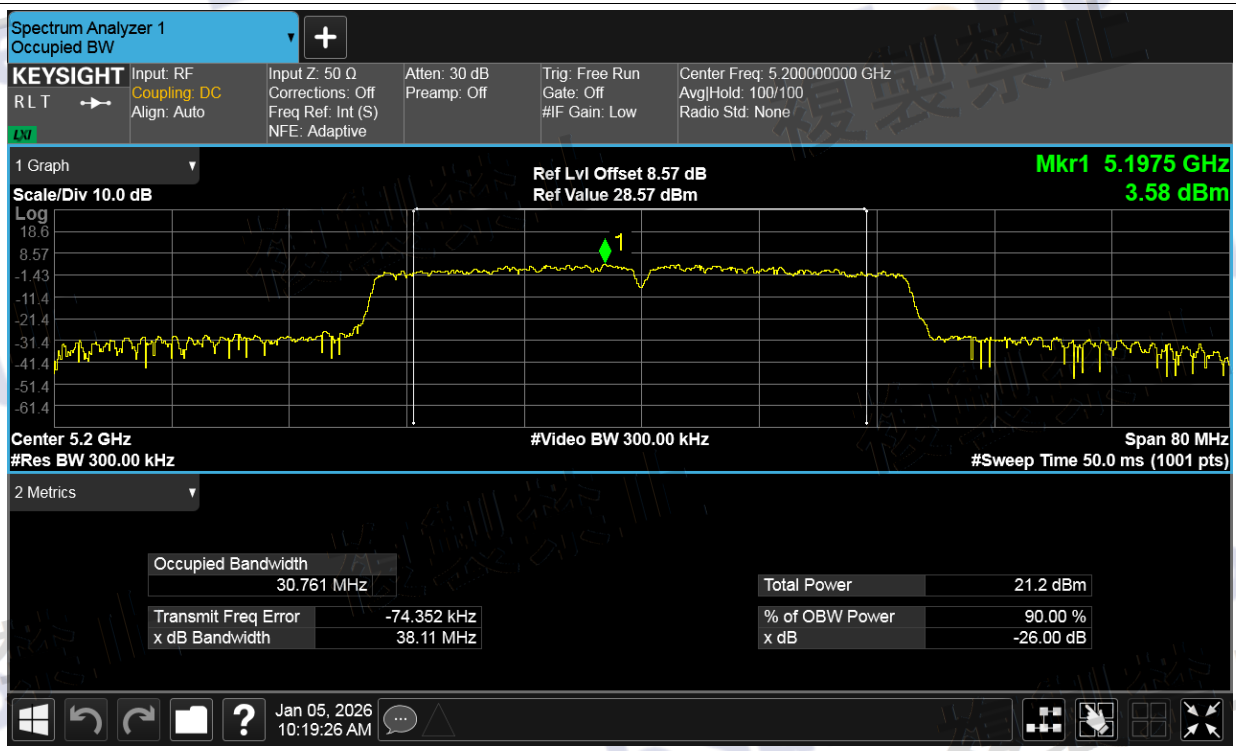


Spreading Bandwidth NVNT n40 5230MHz Ant1

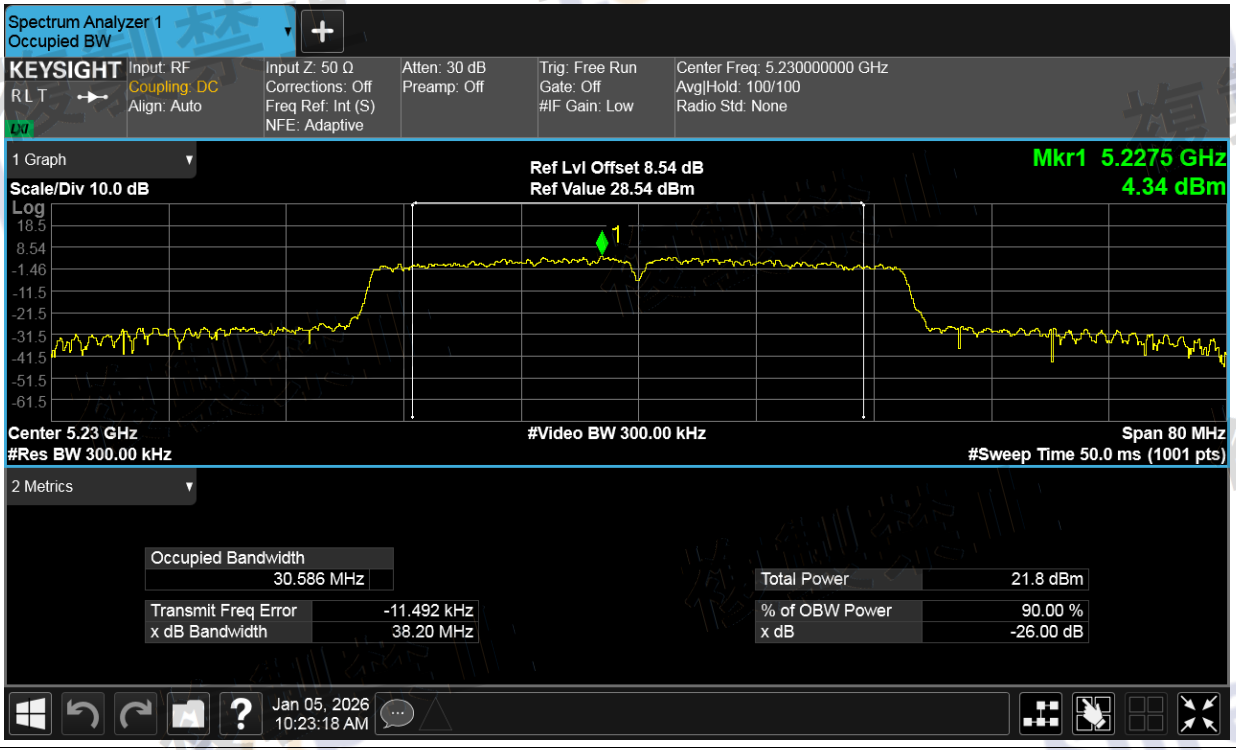


Spreading Bandwidth NVNT n40 5270MHz Ant1



Spreading Bandwidth NVNT n40 5310MHz Ant1

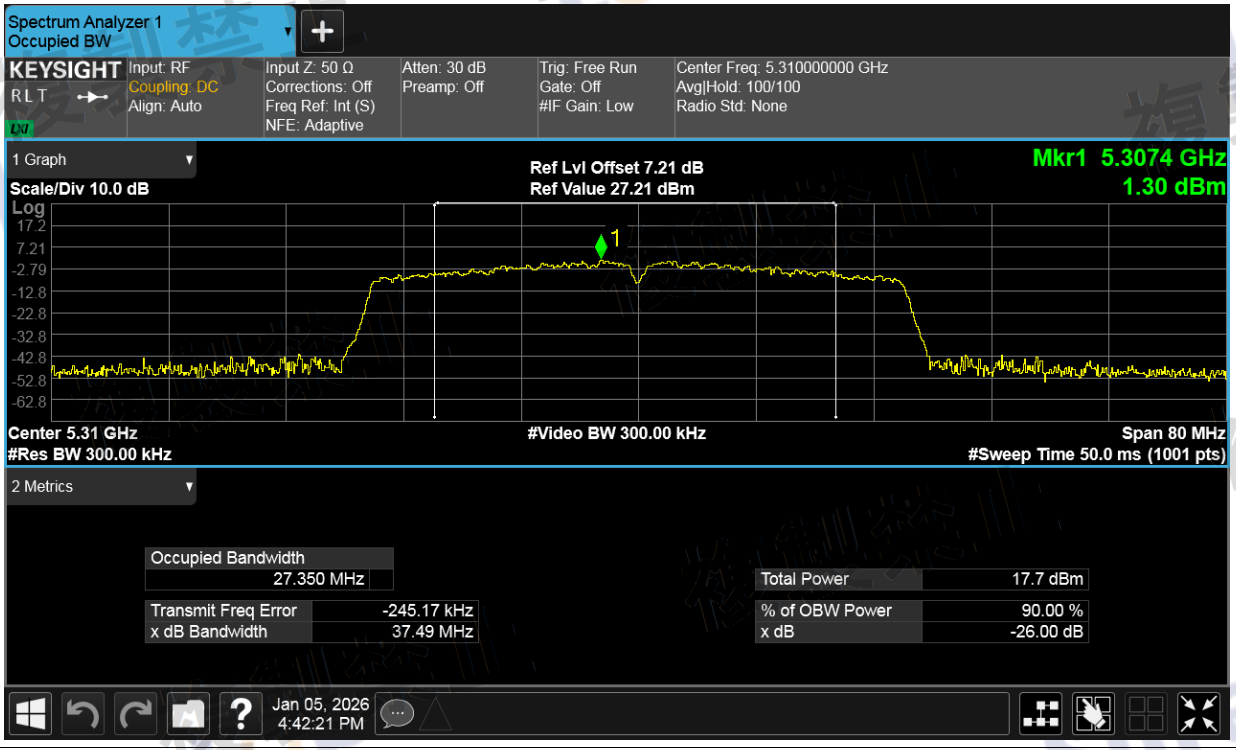

Spreading Bandwidth NVNT n40 5510MHz Ant1

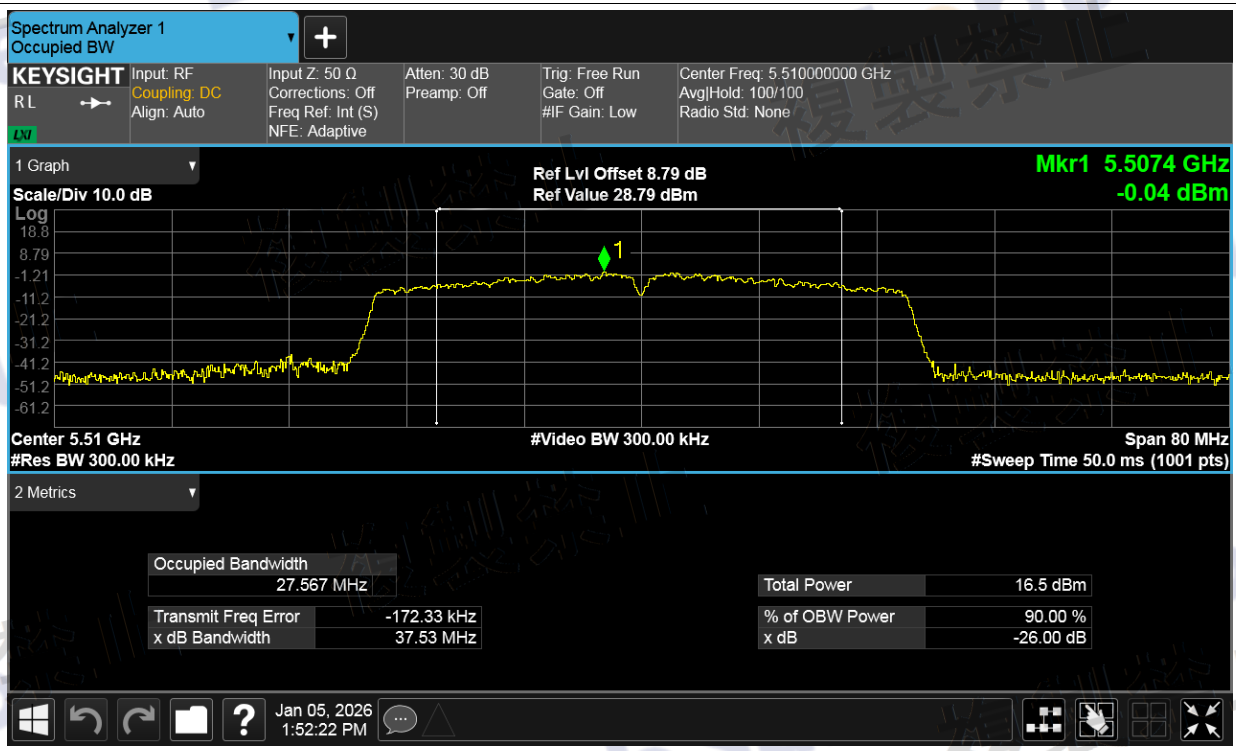


Spreading Bandwidth NVNT n40 5590MHz Ant1




Spreading Bandwidth NVNT n40 5670MHz Ant1




Spreading Bandwidth NVNT ac20 5180MHz Ant1

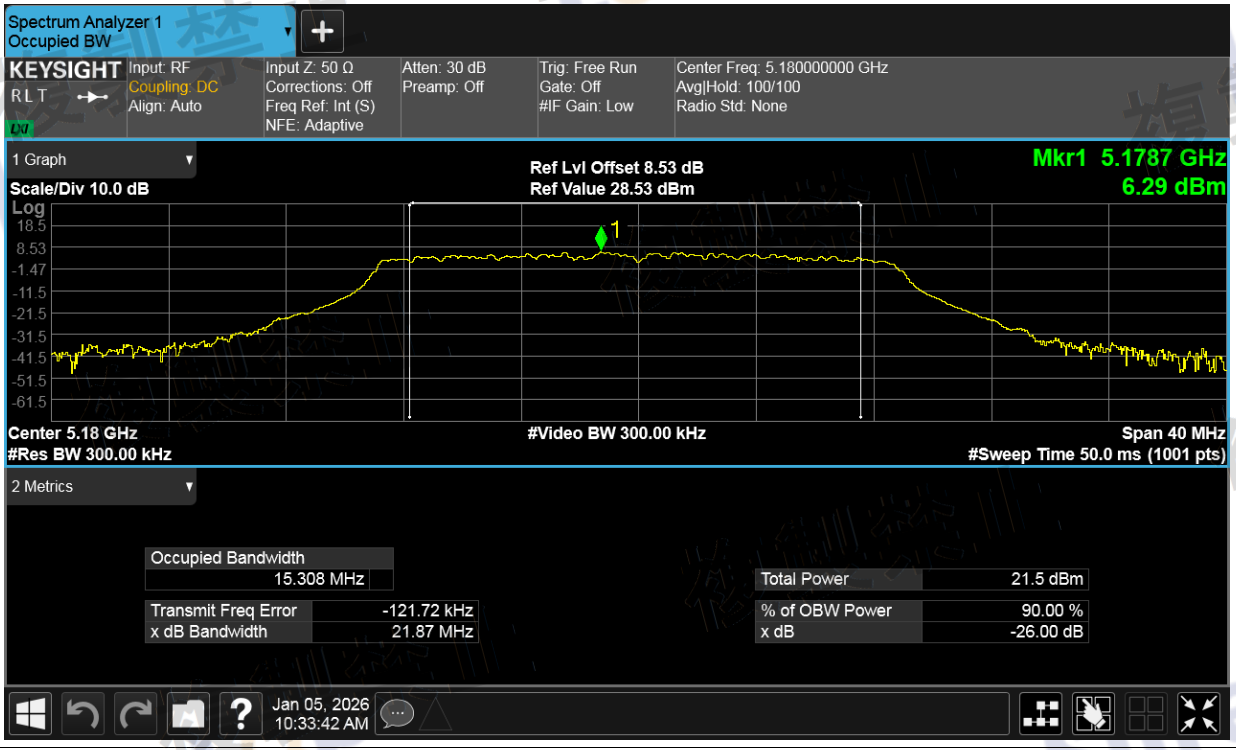


Spreading Bandwidth NVNT ac20 5200MHz Ant1

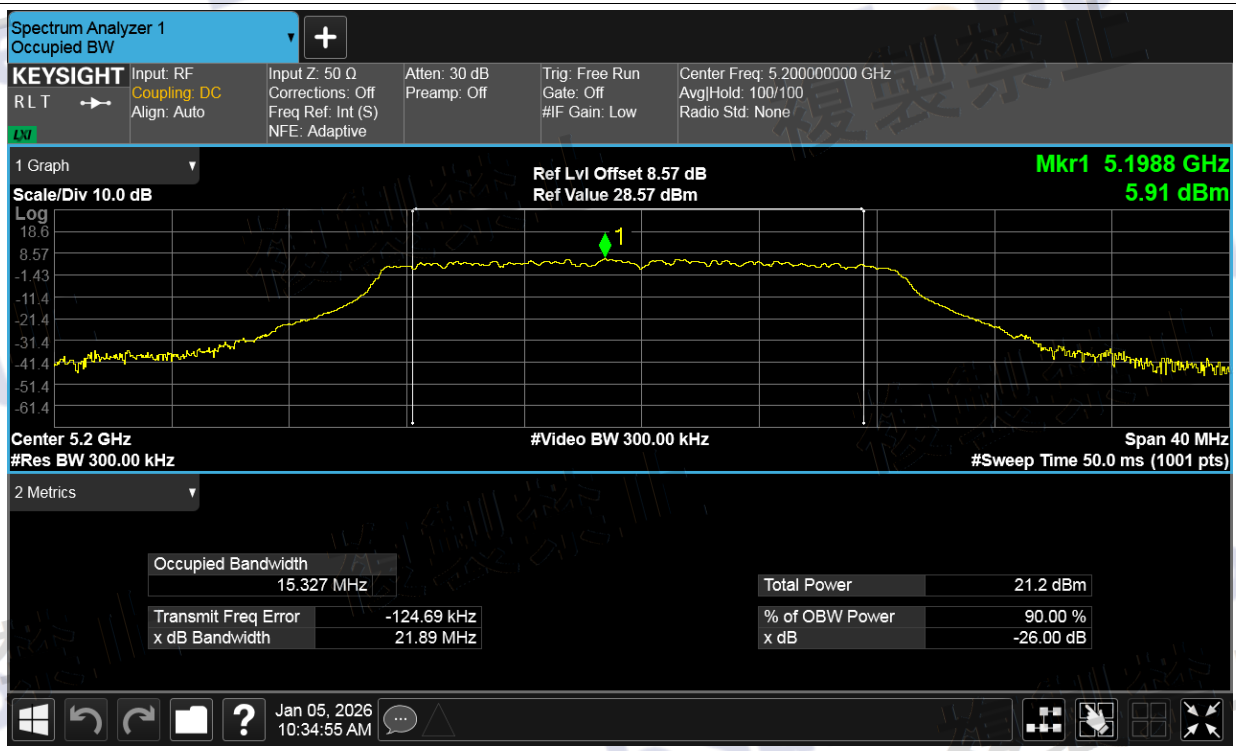


Spreading Bandwidth NVNT ac20 5240MHz Ant1

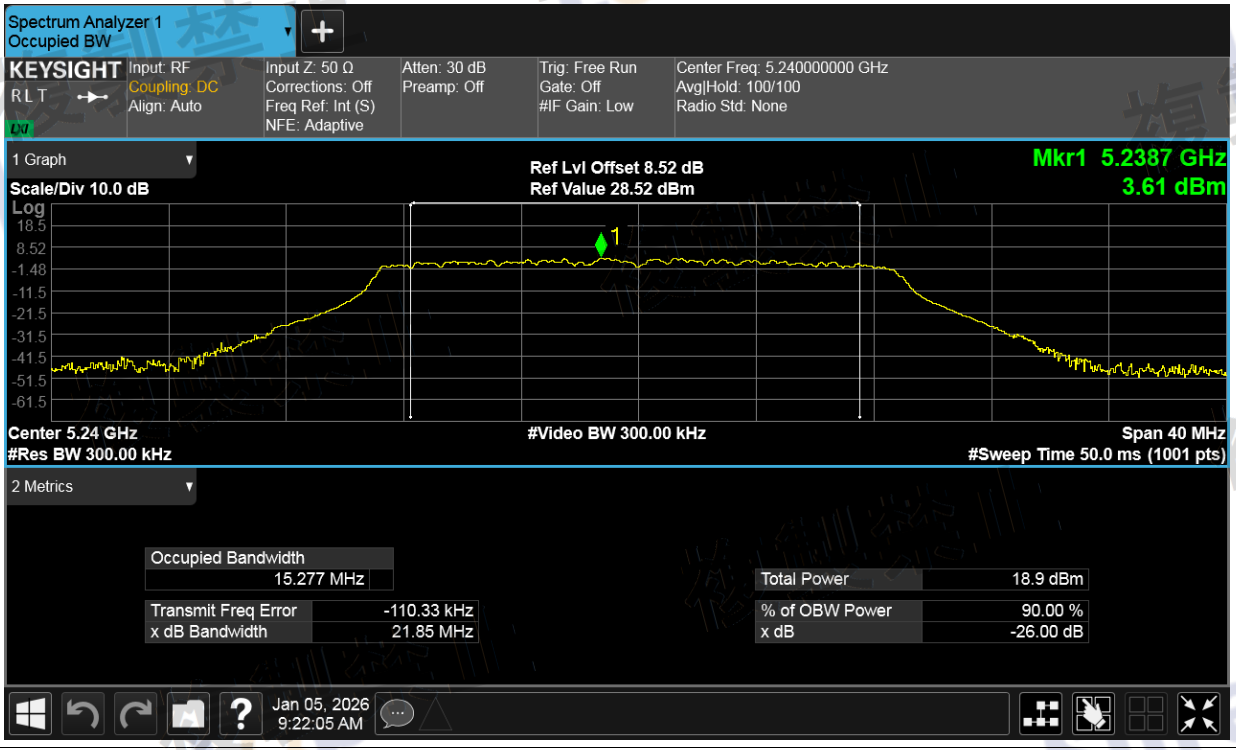


Spreading Bandwidth NVNT ac20 5260MHz Ant1

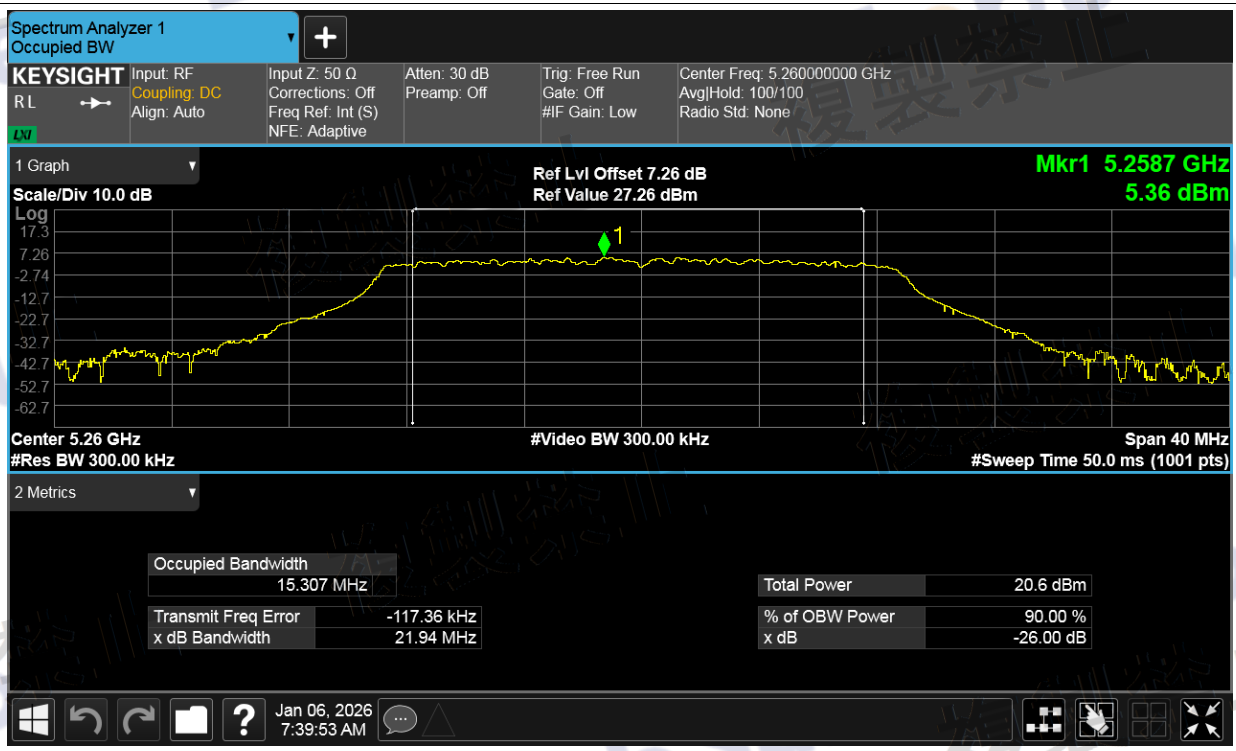


Spreading Bandwidth NVNT ac20 5300MHz Ant1

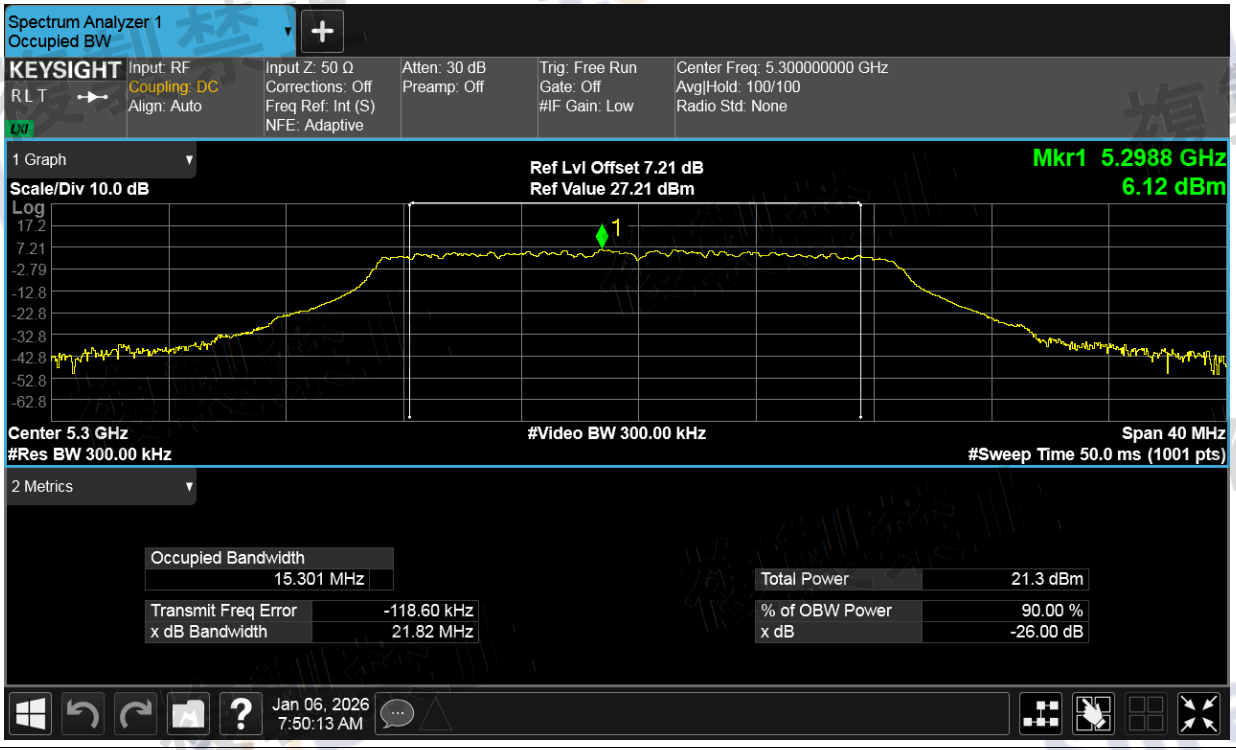


Spreading Bandwidth NVNT ac20 5320MHz Ant1

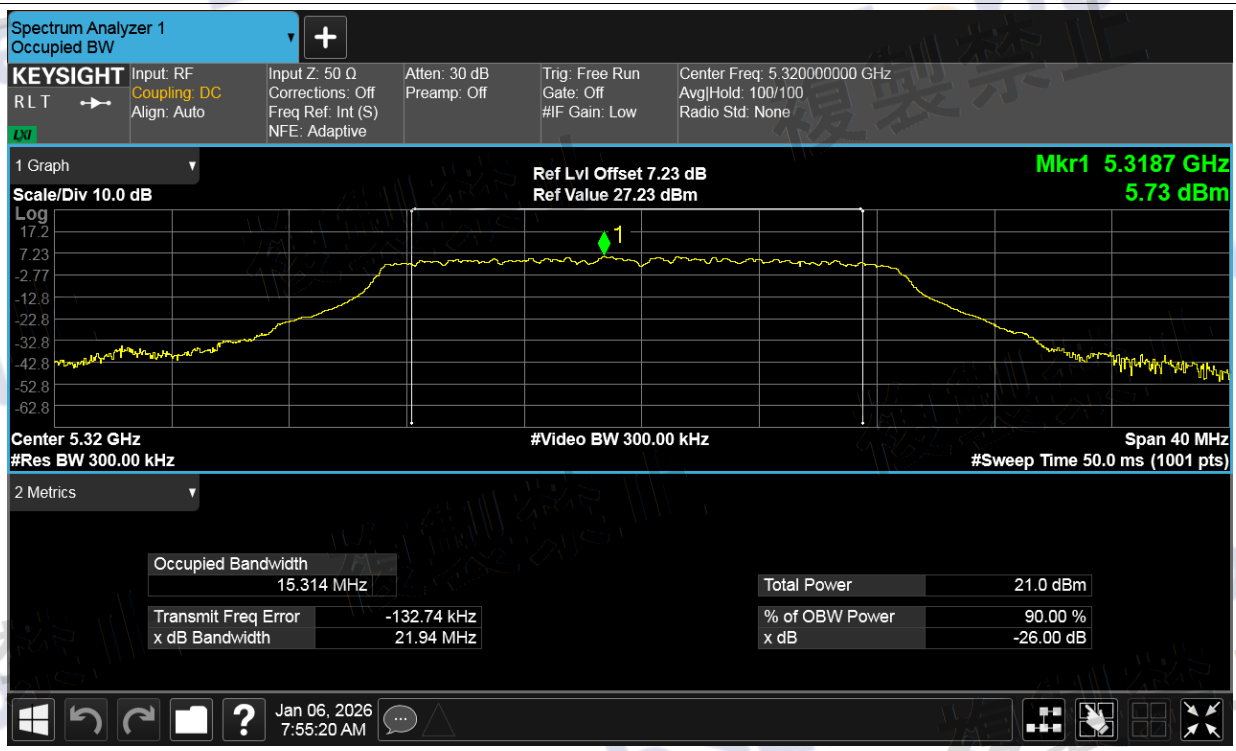


Spreading Bandwidth NVNT ac20 5500MHz Ant1

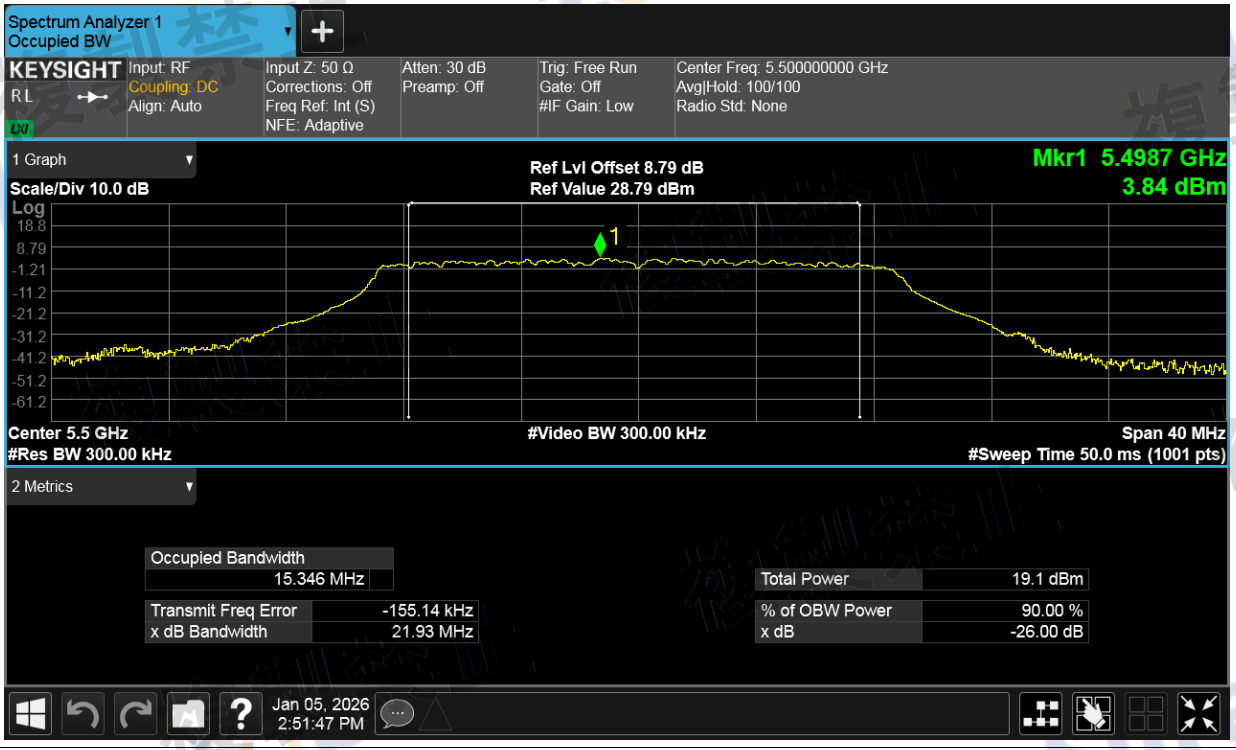

Spreading Bandwidth NVNT ac20 5580MHz Ant1

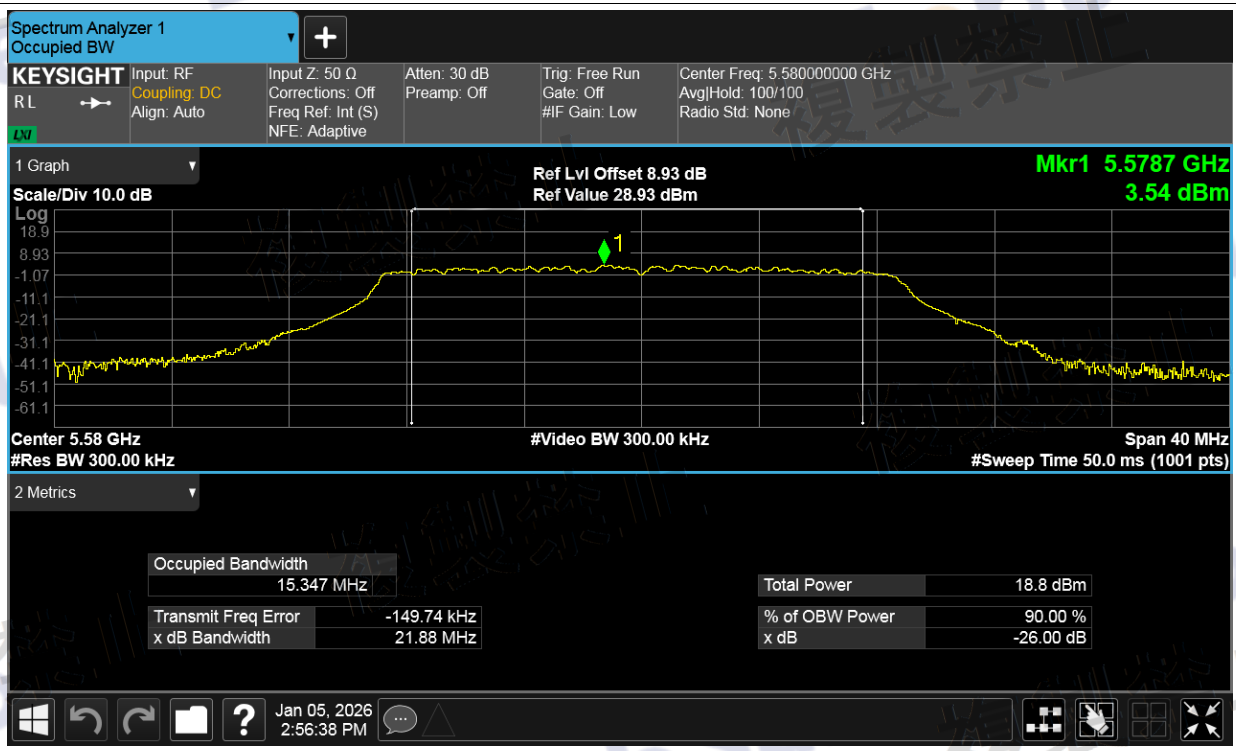


Spreading Bandwidth NVNT ac20 5700MHz Ant1

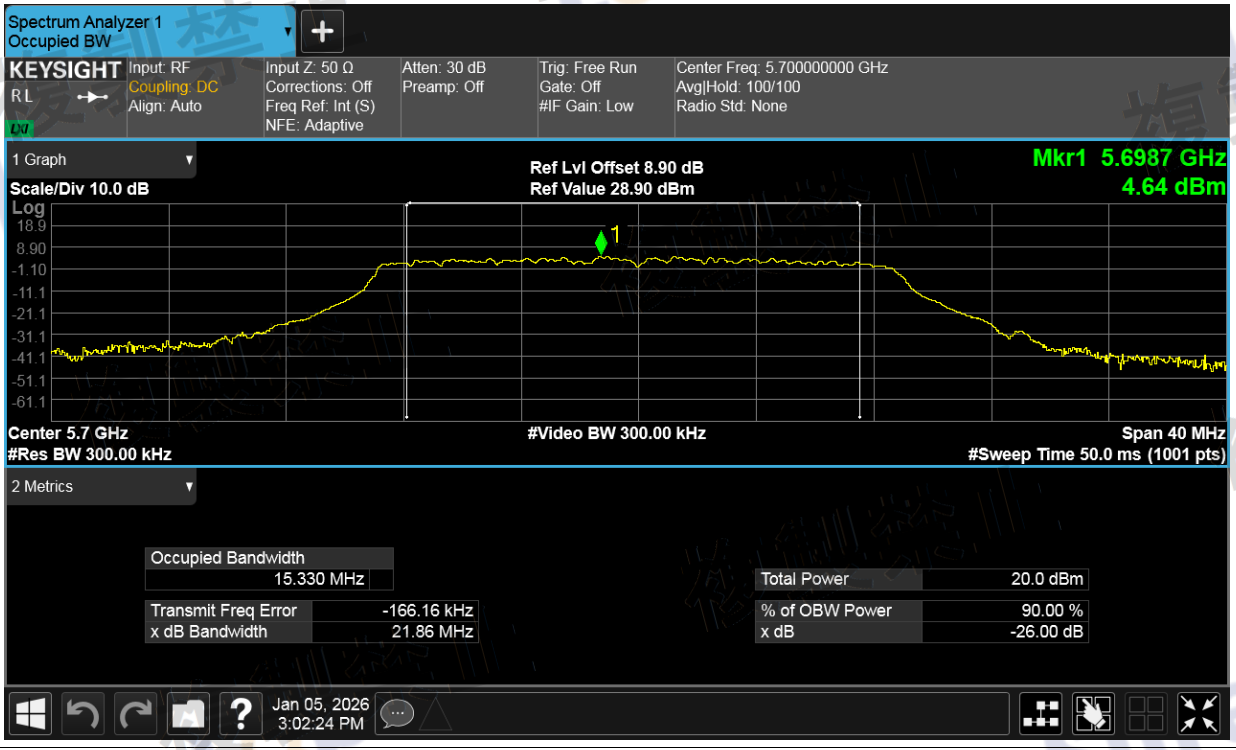

Spreading Bandwidth NVNT ac40 5190MHz Ant1




Spreading Bandwidth NVNT ac40 5200MHz Ant1

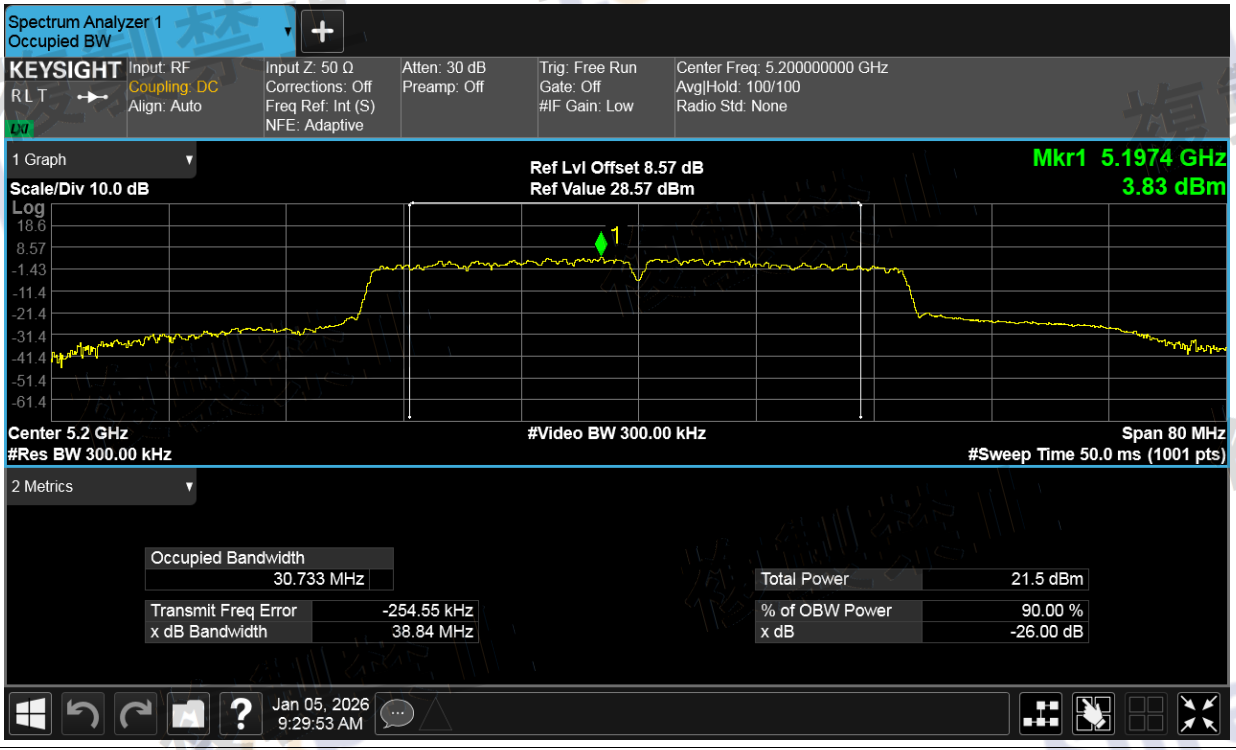

Spreading Bandwidth NVNT ac40 5230MHz Ant1



Spreading Bandwidth NVNT ac40 5270MHz Ant1

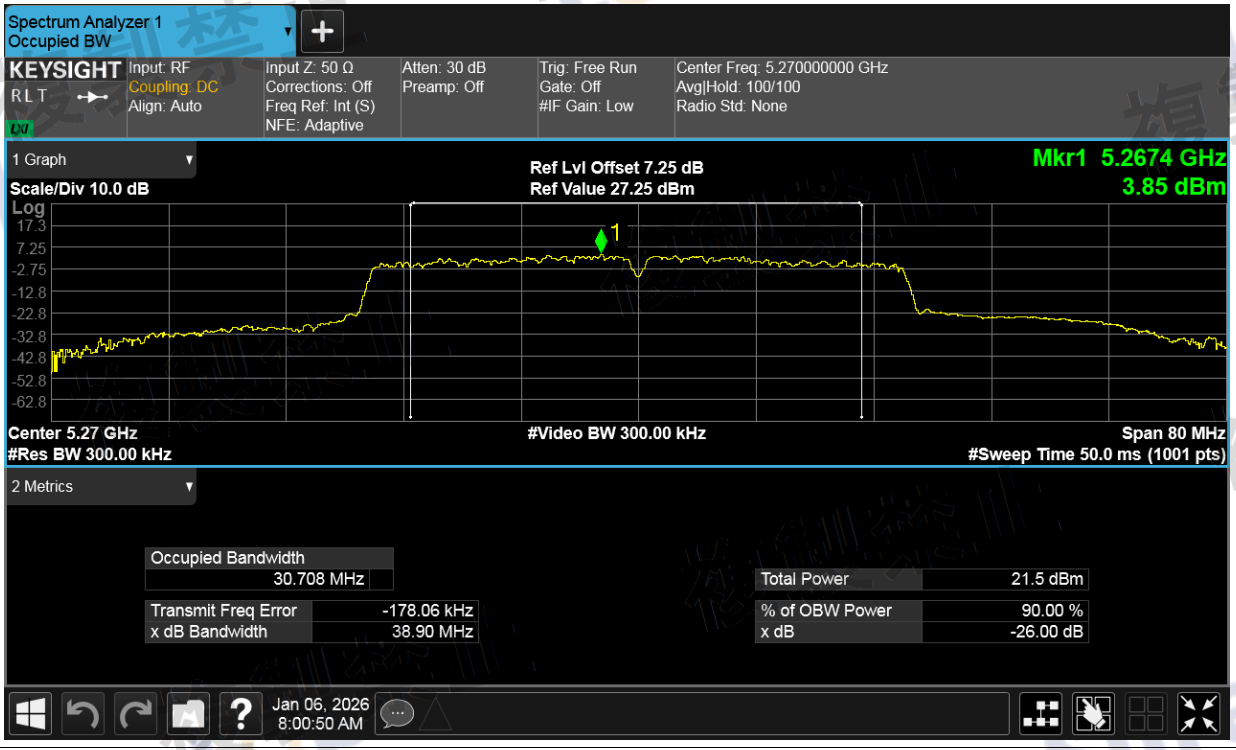

Spreading Bandwidth NVNT ac40 5310MHz Ant1



Spreading Bandwidth NVNT ac40 5510MHz Ant1




Spreading Bandwidth NVNT ac40 5590MHz Ant1




Spreading Bandwidth NVNT ac40 5670MHz Ant1




Spreading Bandwidth NVNT ax20 5180MHz Ant1

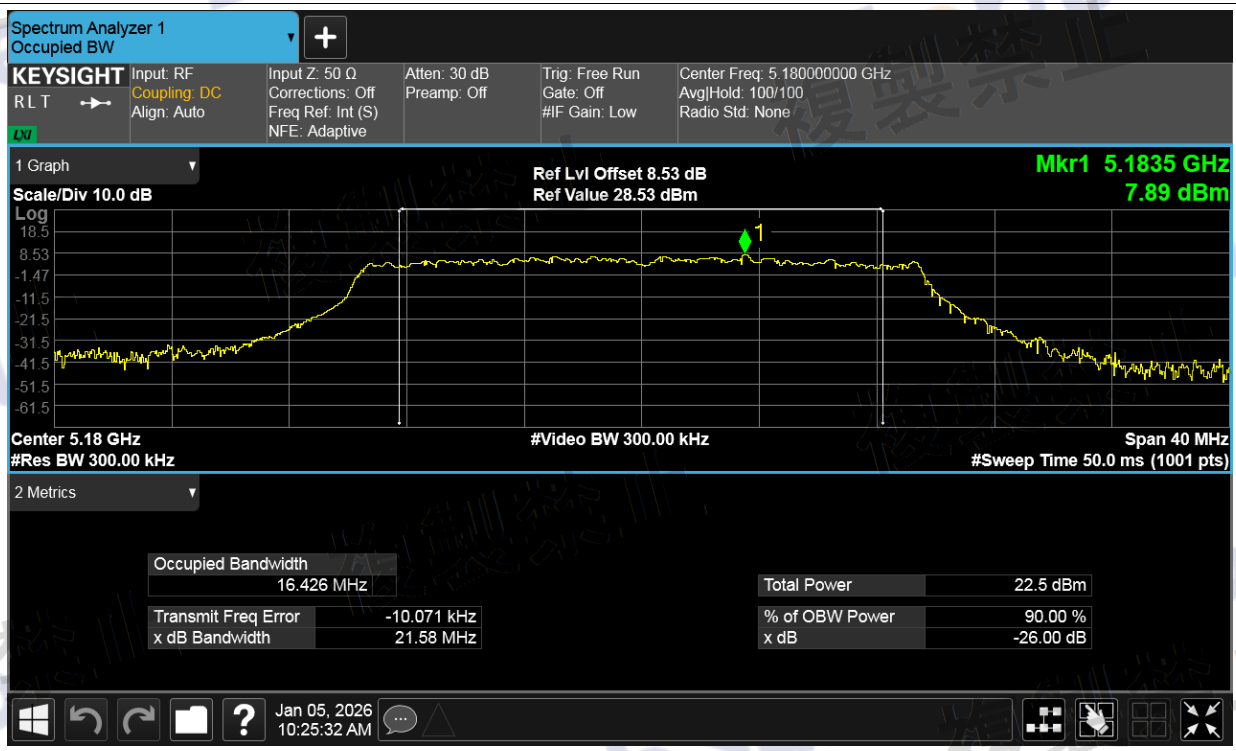

Spreading Bandwidth NVNT ax20 5200MHz Ant1

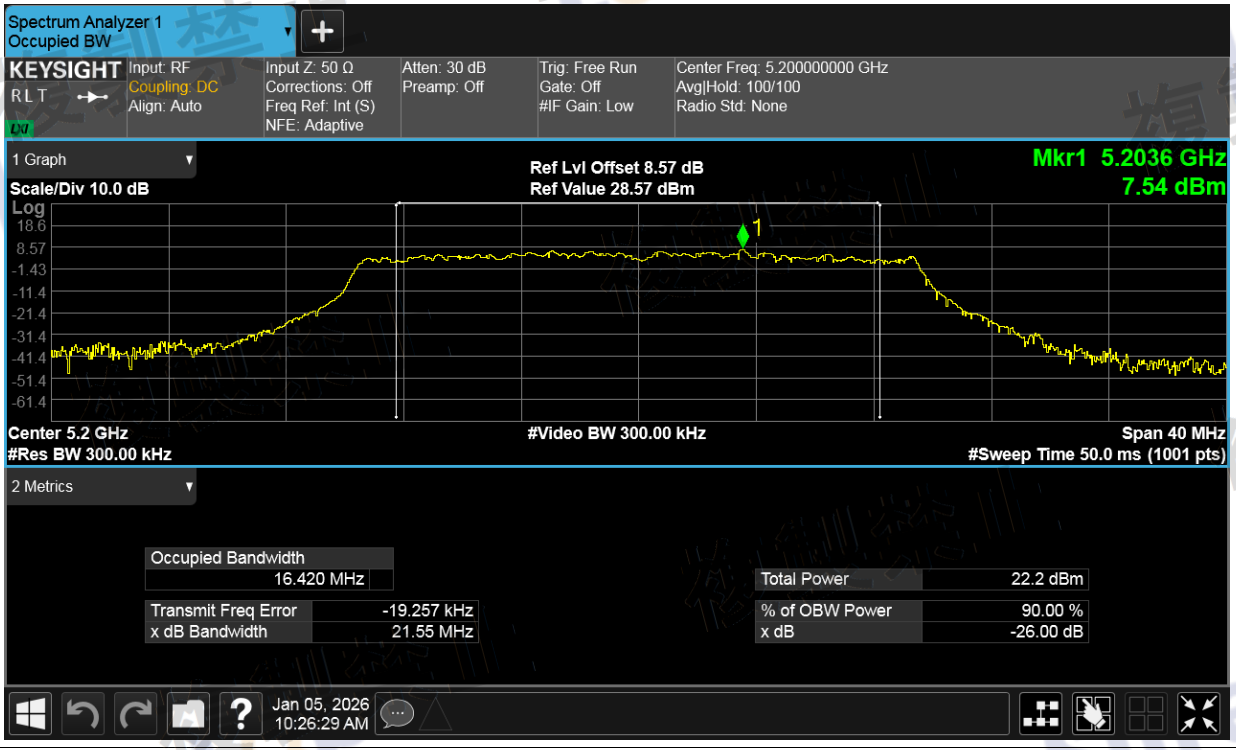


Spreading Bandwidth NVNT ax20 5240MHz Ant1

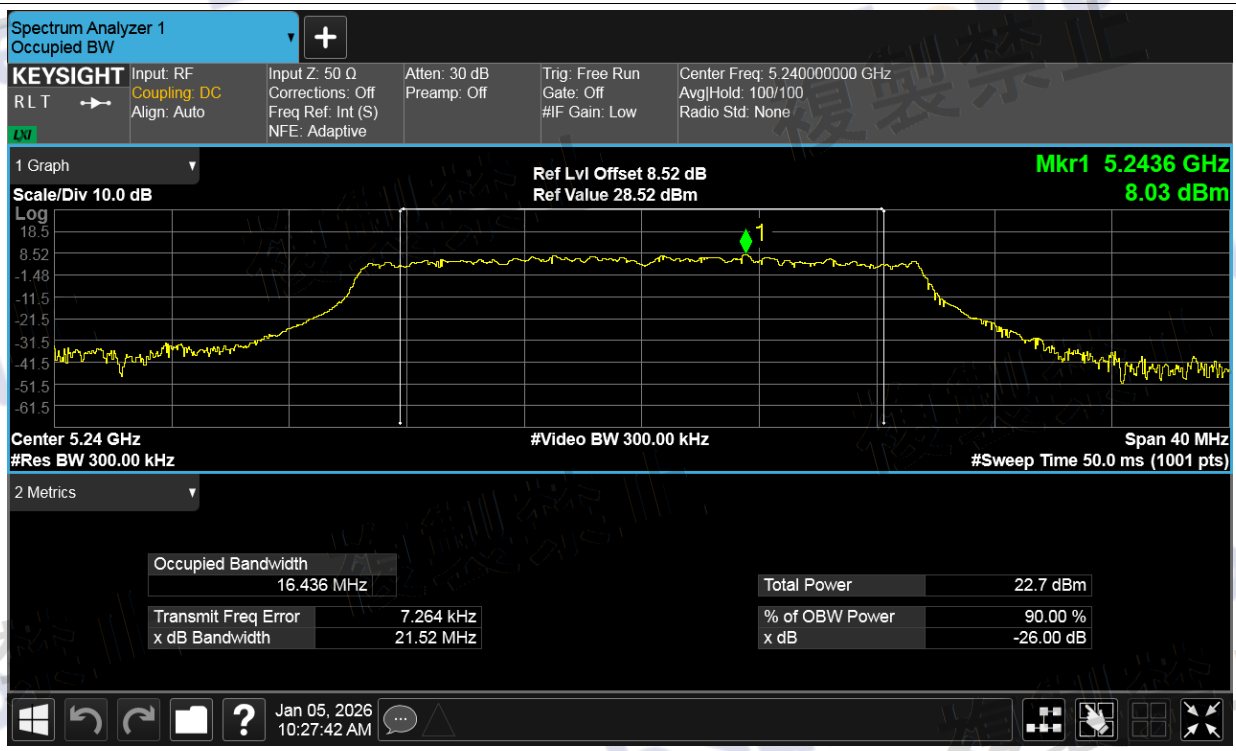

Spreading Bandwidth NVNT ax20 5260MHz Ant1




Spreading Bandwidth NVNT ax20 5300MHz Ant1

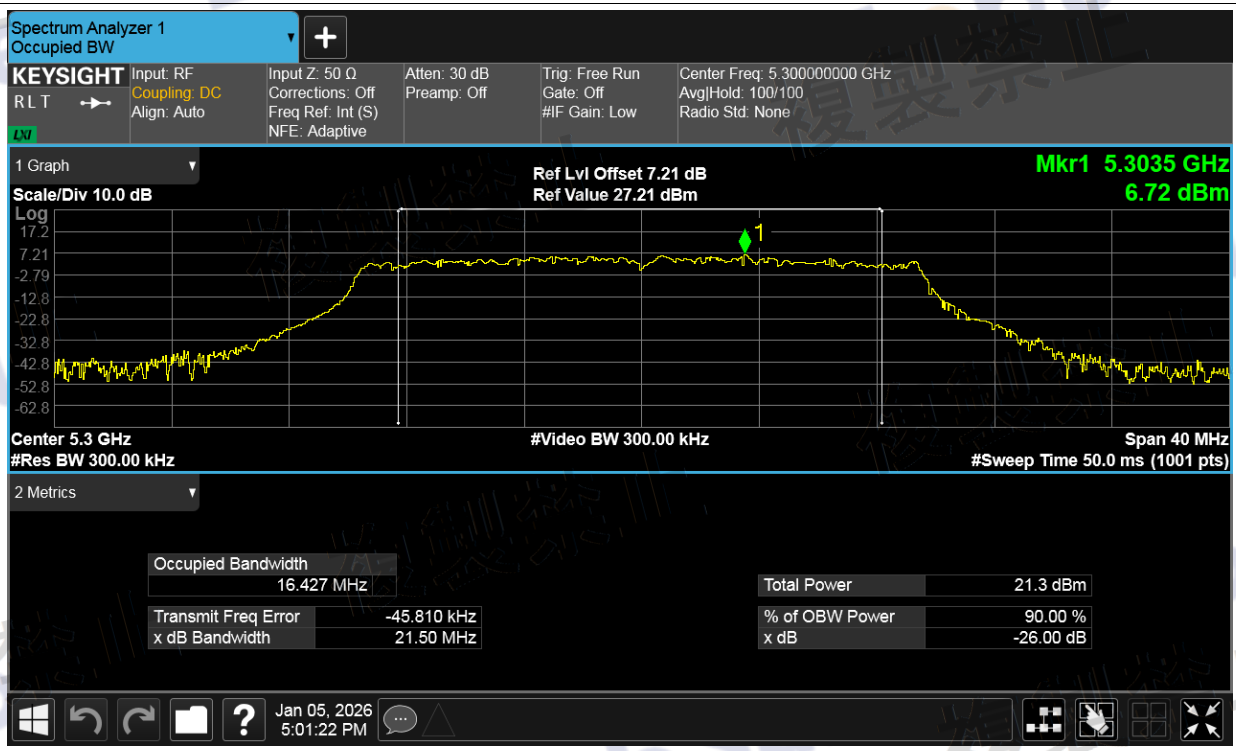


Spreading Bandwidth NVNT ax20 5320MHz Ant1




Spreading Bandwidth NVNT ax20 5500MHz Ant1

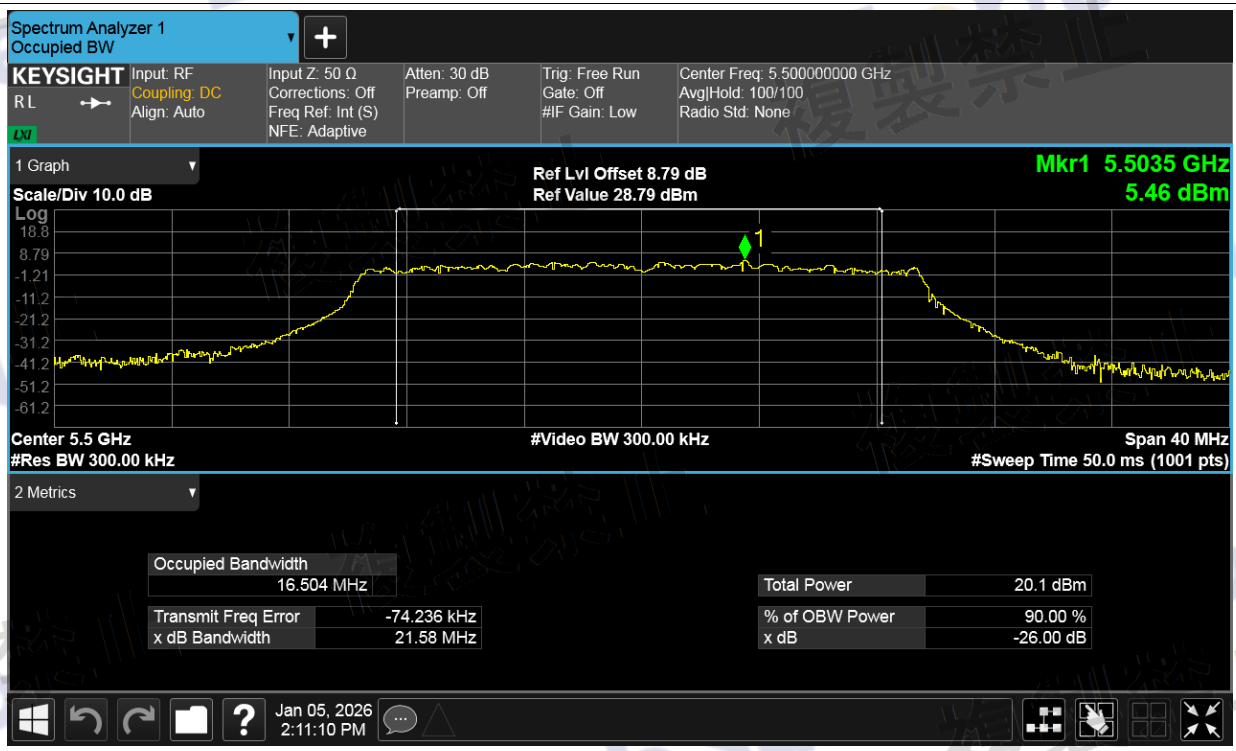


Spreading Bandwidth NVNT ax20 5580MHz Ant1

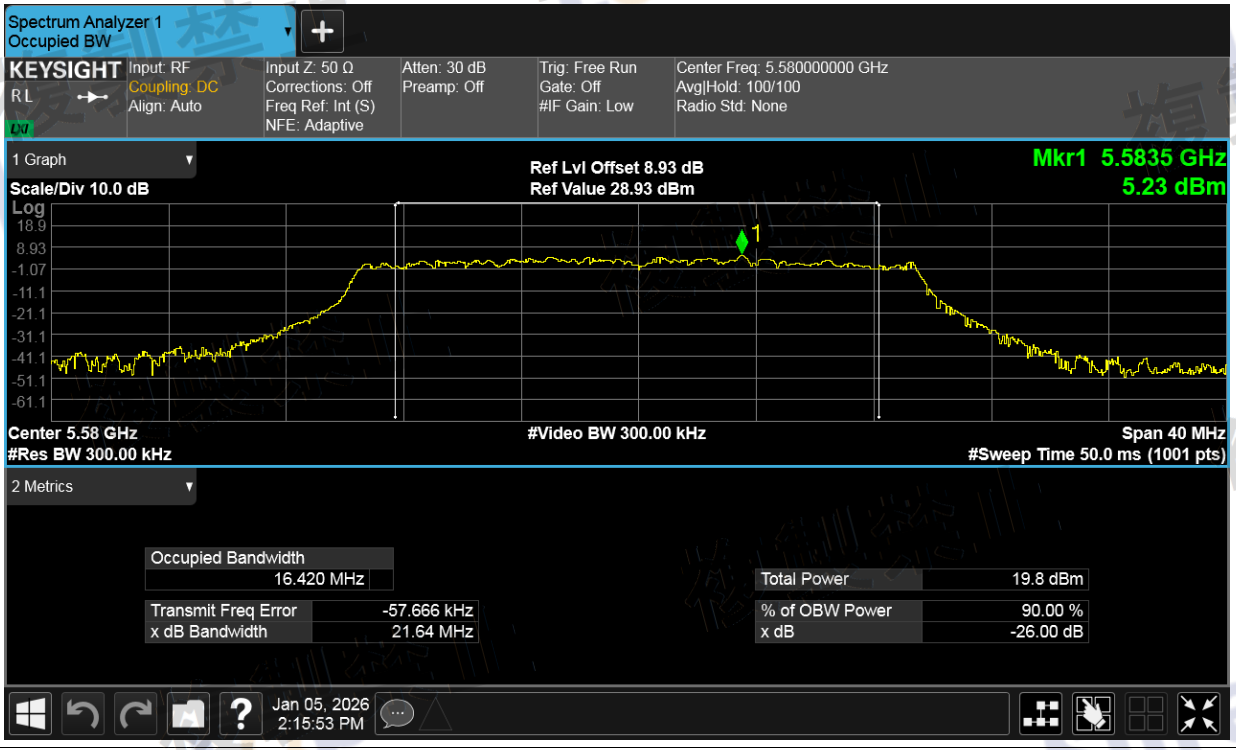


Spreading Bandwidth NVNT ax20 5700MHz Ant1

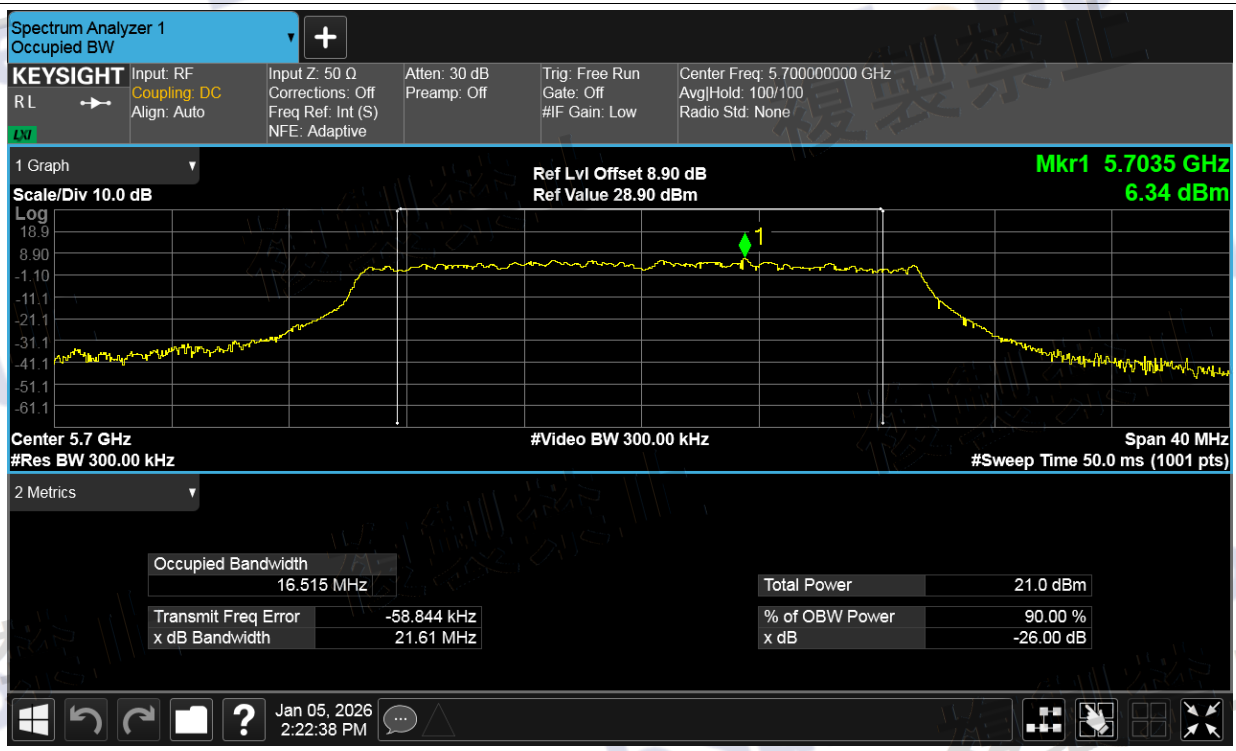


Spreading Bandwidth NVNT ax40 5190MHz Ant1

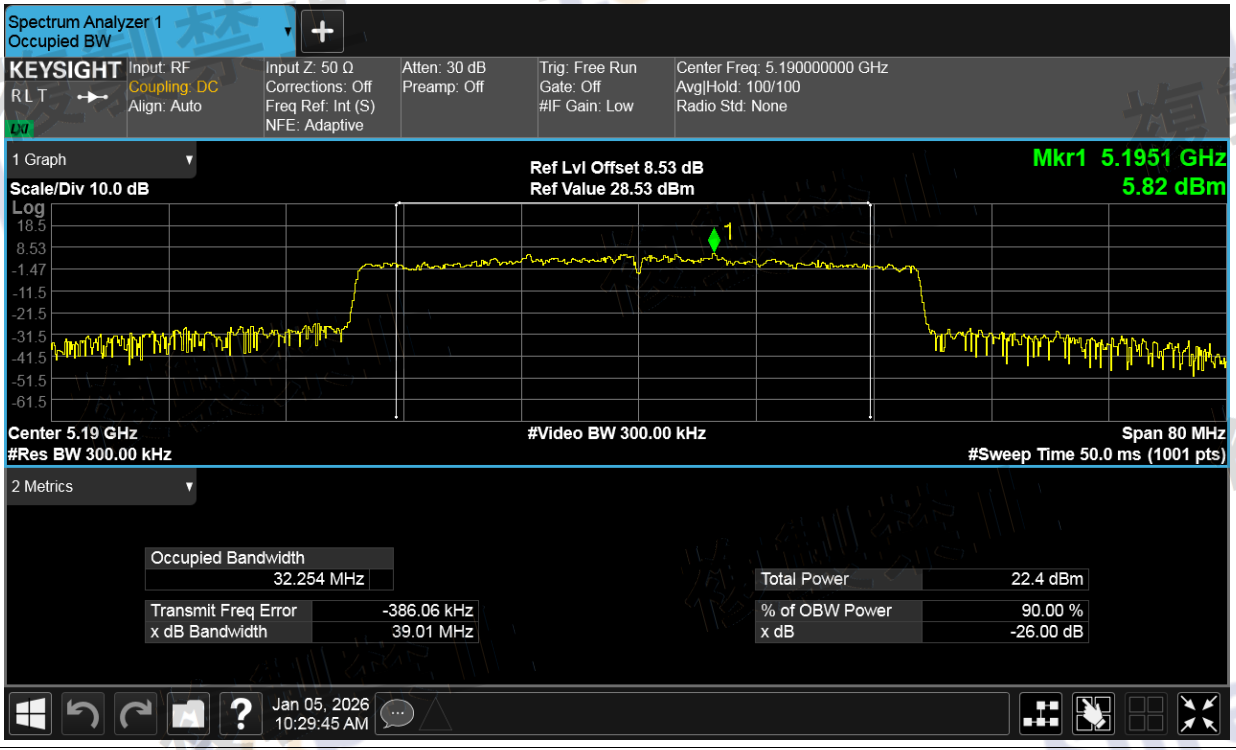


Spreading Bandwidth NVNT ax40 5200MHz Ant1

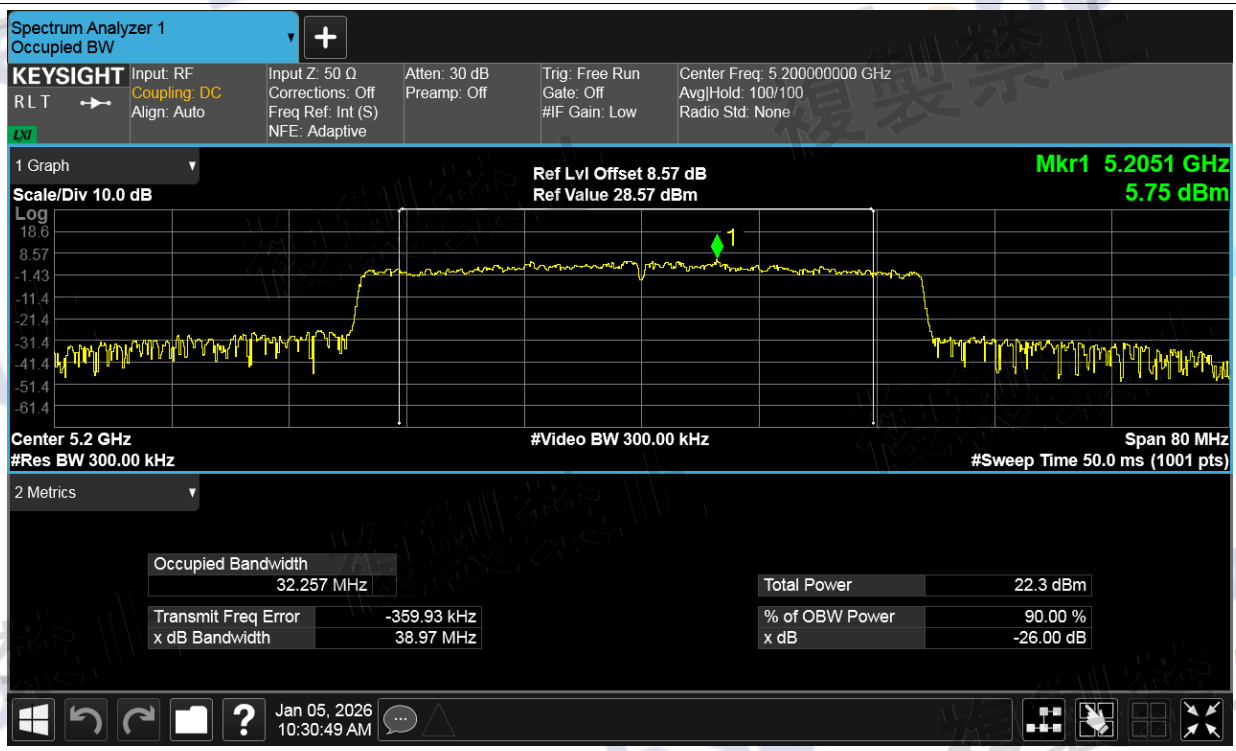


Spreading Bandwidth NVNT ax40 5230MHz Ant1

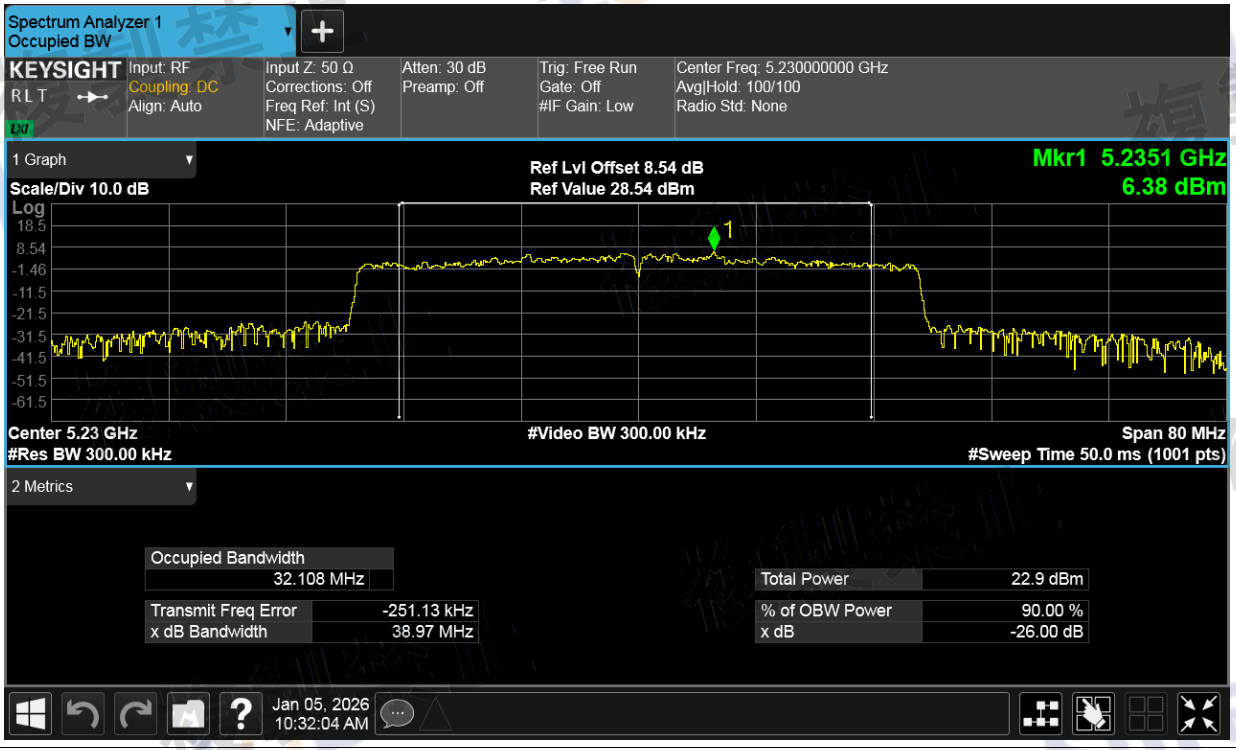

Spreading Bandwidth NVNT ax40 5270MHz Ant1

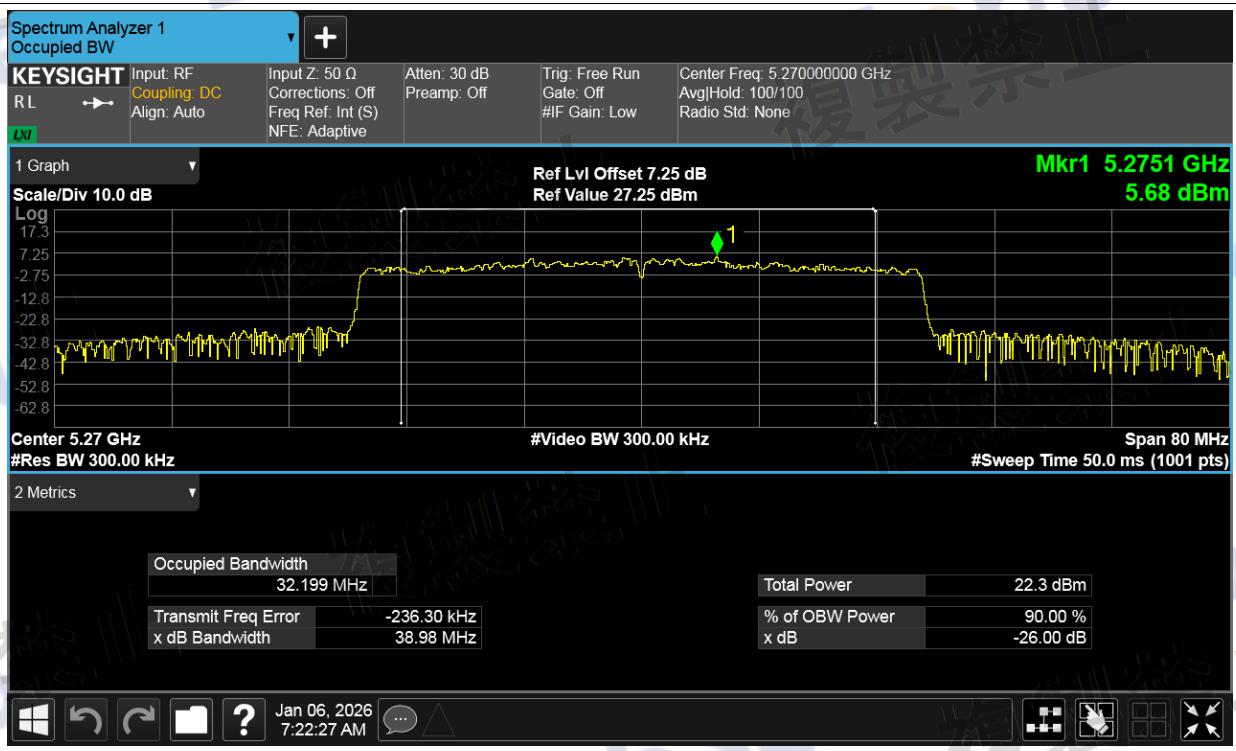

Spreading Bandwidth NVNT ax40 5310MHz Ant1

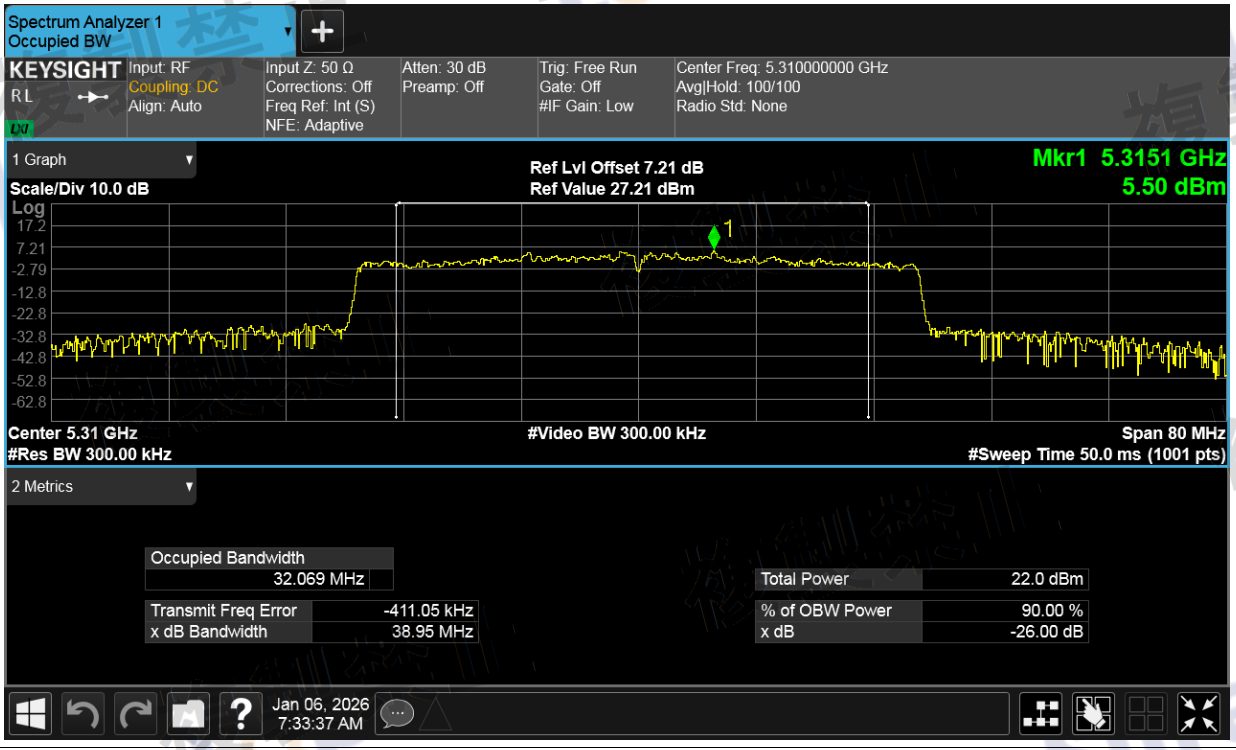

Spreading Bandwidth NVNT ax40 5510MHz Ant1



Spreading Bandwidth NVNT ax40 5590MHz Ant1



Spreading Bandwidth NVNT ax40 5670MHz Ant1



Transmitter Spurious Emissions

Condition	Mode	Frequency (MHz)	Antenna	Range (MHz)	Emission Frequency (MHz)	Max Peak Value (dBm)	Max RMS Value (dBm)	Max Peak Value (uW)	Max RMS Value (uW)	Limit Start(uW)	Limit Stop (uW)	Verdict
NVNT	a	5180	Ant1	30-5142	3858.89	-38.35	NA	0.1462	NA	2.5	2.5	Pass
NVNT	a	5180	Ant1	5142-5150	5144.62	-36.37	NA	0.2307	NA	15	15	Pass
NVNT	a	5180	Ant1	5250-5251	5250.99	-41.75	NA	0.0668	NA	1000	100	Pass
NVNT	a	5180	Ant1	5251-5260	5259.96	-41.76	NA	0.0667	NA	100	15.85	Pass
NVNT	a	5180	Ant1	5260-5266.7	5266.00	-39.42	NA	0.1143	NA	15.85	2.49	Pass
NVNT	a	5180	Ant1	5266.7-26000	23781.54	-37.26	NA	0.1879	NA	2.5	2.5	Pass
NVNT	a	5200	Ant1	30-5142	3853.78	-37.67	NA	0.171	NA	2.5	2.5	Pass
NVNT	a	5200	Ant1	5142-5150	5148.20	-37.32	NA	0.1854	NA	15	15	Pass
NVNT	a	5200	Ant1	5250-5251	5251.00	-41.18	NA	0.0762	NA	1000	100	Pass
NVNT	a	5200	Ant1	5251-5260	5259.84	-41.06	NA	0.0783	NA	100	15.85	Pass
NVNT	a	5200	Ant1	5260-5266.7	5265.69	-39.22	NA	0.1197	NA	15.85	2.49	Pass
NVNT	a	5200	Ant1	5266.7-26000	25564.60	-36.97	NA	0.2009	NA	2.5	2.5	Pass
NVNT	a	5240	Ant1	30-5142	3807.77	-36.70	NA	0.2138	NA	2.5	2.5	Pass
NVNT	a	5240	Ant1	5142-5150	5143.92	-38.14	NA	0.1535	NA	15	15	Pass
NVNT	a	5240	Ant1	5250-5251	5251.00	-14.66	NA	34.1979	NA	1000	100	Pass
NVNT	a	5240	Ant1	5251-5260	5251.01	-15.00	NA	31.6228	NA	100	15.85	Pass
NVNT	a	5240	Ant1	5260-5266.7	5266.59	-39.51	NA	0.1119	NA	15.85	2.49	Pass
NVNT	a	5240	Ant1	5266.7-26000	25295.07	-37.07	NA	0.1963	NA	2.5	2.5	Pass
NVNT	a	5260	Ant1	30-5233.3	3818.00	-40.08	NA	0.0982	NA	2.5	2.5	Pass
NVNT	a	5260	Ant1	5233.3-5240	5234.30	-40.46	NA	0.0899	NA	2.49	15.85	Pass
NVNT	a	5260	Ant1	5240-5249	5248.98	-13.15	NA	48.4172	NA	15.85	100	Pass
NVNT	a	5260	Ant1	5249-5250	5249.00	-13.15	NA	48.4172	NA	100	1000	Pass
NVNT	a	5260	Ant1	5350-26000	24079.55	-38.63	NA	0.1371	NA	2.5	2.5	Pass
NVNT	a	5300	Ant1	30-5233.3	3765.97	-39.91	NA	0.1021	NA	2.5	2.5	Pass
NVNT	a	5300	Ant1	5233.3-5240	5233.57	-41.86	NA	0.0652	NA	2.49	15.85	Pass
NVNT	a	5300	Ant1	5240-5249	5240.17	-41.35	NA	0.0733	NA	15.85	100	Pass
NVNT	a	5300	Ant1	5249-5250	5249.03	-42.10	NA	0.0617	NA	100	1000	Pass
NVNT	a	5300	Ant1	5350-26000	25545.70	-38.88	NA	0.1294	NA	2.5	2.5	Pass
NVNT	a	5320	Ant1	30-5233.3	5072.00	-40.39	NA	0.0914	NA	2.5	2.5	Pass
NVNT	a	5320	Ant1	5233.3-5240	5233.31	-42.06	NA	0.0622	NA	2.49	15.85	Pass
NVNT	a	5320	Ant1	5240-5249	5240.79	-42.03	NA	0.0627	NA	15.85	100	Pass
NVNT	a	5320	Ant1	5249-5250	5249.06	-41.20	NA	0.0759	NA	100	1000	Pass
NVNT	a	5320	Ant1	5350-26000	25235.95	-39.38	NA	0.1153	NA	2.5	2.5	Pass
NVNT	a	5500	Ant1	30-5460	3885.30	-39.17	NA	0.1211	NA	2.5	2.5	Pass
NVNT	a	5500	Ant1	5460-5470	5466.35	-41.43	NA	0.0719	NA	12.5	12.5	Pass
NVNT	a	5500	Ant1	5745-5765	5749.94	-39.11	NA	0.1227	NA	12.5	12.5	Pass
NVNT	a	5500	Ant1	5765-26000	25919.06	-36.65	NA	0.2163	NA	2.5	2.5	Pass
NVNT	a	5580	Ant1	30-5460	3809.28	-38.28	NA	0.1486	NA	2.5	2.5	Pass

NVNT	a	5580	Ant1	5460-5470	5464.10	-41.40	NA	0.0724	NA	12.5	12.5	Pass
NVNT	a	5580	Ant1	5745-5765	5762.82	-40.90	NA	0.0813	NA	12.5	12.5	Pass
NVNT	a	5580	Ant1	5765-26000	25635.77	-38.18	NA	0.1521	NA	2.5	2.5	Pass
NVNT	a	5700	Ant1	30-5460	3825.57	-40.03	NA	0.0993	NA	2.5	2.5	Pass
NVNT	a	5700	Ant1	5460-5470	5468.03	-41.83	NA	0.0656	NA	12.5	12.5	Pass
NVNT	a	5700	Ant1	5745-5765	5755.28	-39.15	NA	0.1216	NA	12.5	12.5	Pass
NVNT	a	5700	Ant1	5765-26000	24057.44	-37.17	NA	0.1919	NA	2.5	2.5	Pass
NVNT	n20	5180	Ant1	30-5142	3720.86	-38.37	NA	0.1455	NA	2.5	2.5	Pass
NVNT	n20	5180	Ant1	5142-5150	5142.78	-37.24	NA	0.1888	NA	15	15	Pass
NVNT	n20	5180	Ant1	5250-5251	5250.91	-40.70	NA	0.0851	NA	1000	100	Pass
NVNT	n20	5180	Ant1	5251-5260	5259.59	-40.11	NA	0.0975	NA	100	15.85	Pass
NVNT	n20	5180	Ant1	5260-5266.7	5266.64	-39.98	NA	0.1005	NA	15.85	2.49	Pass
NVNT	n20	5180	Ant1	5266.7-26000	24071.80	-37.09	NA	0.1954	NA	2.5	2.5	Pass
NVNT	n20	5200	Ant1	30-5142	3807.77	-38.60	NA	0.138	NA	2.5	2.5	Pass
NVNT	n20	5200	Ant1	5142-5150	5142.19	-38.03	NA	0.1574	NA	15	15	Pass
NVNT	n20	5200	Ant1	5250-5251	5250.96	-38.53	NA	0.1403	NA	1000	100	Pass
NVNT	n20	5200	Ant1	5251-5260	5259.92	-41.16	NA	0.0766	NA	100	15.85	Pass
NVNT	n20	5200	Ant1	5260-5266.7	5266.36	-39.59	NA	0.1099	NA	15.85	2.49	Pass
NVNT	n20	5200	Ant1	5266.7-26000	24051.07	-37.23	NA	0.1892	NA	2.5	2.5	Pass
NVNT	n20	5240	Ant1	30-5142	3889.56	-46.84	NA	0.0207	NA	2.5	2.5	Pass
NVNT	n20	5240	Ant1	5142-5150	5149.81	-45.34	NA	0.0292	NA	15	15	Pass
NVNT	n20	5240	Ant1	5250-5251	5251.00	-16.69	NA	21.4289	NA	1000	100	Pass
NVNT	n20	5240	Ant1	5251-5260	5251.00	-16.96	NA	20.1372	NA	100	15.85	Pass
NVNT	n20	5240	Ant1	5260-5266.7	5266.50	-32.42	NA	0.5728	NA	15.85	2.49	Pass
NVNT	n20	5240	Ant1	5266.7-26000	5266.70	-33.29	NA	0.4688	NA	2.5	2.5	Pass
NVNT	n20	5260	Ant1	30-5233.3	3724.34	-38.91	NA	0.1285	NA	2.5	2.5	Pass
NVNT	n20	5260	Ant1	5233.3-5240	5234.00	-39.75	NA	0.1059	NA	2.49	15.85	Pass
NVNT	n20	5260	Ant1	5240-5249	5249.00	-10.88	-23.035	81.6582	4.9716	15.85	100	Pass
NVNT	n20	5260	Ant1	5249-5250	5249.00	-11.02	-23.031	79.0679	4.9762	100	1000	Pass
NVNT	n20	5260	Ant1	5350-26000	25710.90	-38.14	NA	0.1535	NA	2.5	2.5	Pass
NVNT	n20	5300	Ant1	30-5233.3	3755.56	-40.39	NA	0.0914	NA	2.5	2.5	Pass
NVNT	n20	5300	Ant1	5233.3-5240	5234.02	-41.59	NA	0.0693	NA	2.49	15.85	Pass
NVNT	n20	5300	Ant1	5240-5249	5240.05	-40.59	NA	0.0873	NA	15.85	100	Pass
NVNT	n20	5300	Ant1	5249-5250	5249.12	-40.14	NA	0.0968	NA	100	1000	Pass
NVNT	n20	5300	Ant1	5350-26000	25587.00	-37.38	NA	0.1828	NA	2.5	2.5	Pass
NVNT	n20	5320	Ant1	30-5233.3	722.04	-31.87	NA	0.6501	NA	2.5	2.5	Pass
NVNT	n20	5320	Ant1	5233.3-5240	5233.36	-42.25	NA	0.0596	NA	2.49	15.85	Pass
NVNT	n20	5320	Ant1	5240-5249	5240.01	-42.40	NA	0.0575	NA	15.85	100	Pass
NVNT	n20	5320	Ant1	5249-5250	5249.06	-40.69	NA	0.0853	NA	100	1000	Pass
NVNT	n20	5320	Ant1	5350-26000	25132.70	-37.97	NA	0.1596	NA	2.5	2.5	Pass
NVNT	n20	5500	Ant1	30-5460	3771.27	-39.06	NA	0.1242	NA	2.5	2.5	Pass
NVNT	n20	5500	Ant1	5460-5470	5468.71	-39.79	NA	0.105	NA	12.5	12.5	Pass
NVNT	n20	5500	Ant1	5745-5765	5763.74	-39.39	NA	0.1151	NA	12.5	12.5	Pass
NVNT	n20	5500	Ant1	5765-26000	25048.96	-36.84	NA	0.207	NA	2.5	2.5	Pass

NVNT	n20	5580	Ant1	30-5460	3841.86	-37.83	NA	0.1648	NA	2.5	2.5	Pass
NVNT	n20	5580	Ant1	5460-5470	5460.59	-39.78	NA	0.1052	NA	12.5	12.5	Pass
NVNT	n20	5580	Ant1	5745-5765	5753.40	-38.77	NA	0.1327	NA	12.5	12.5	Pass
NVNT	n20	5580	Ant1	5765-26000	25656.00	-36.84	NA	0.207	NA	2.5	2.5	Pass
NVNT	n20	5700	Ant1	30-5460	3792.99	-36.19	NA	0.2404	NA	2.5	2.5	Pass
NVNT	n20	5700	Ant1	5460-5470	5464.79	-39.85	NA	0.1035	NA	12.5	12.5	Pass
NVNT	n20	5700	Ant1	5745-5765	5757.98	-39.43	NA	0.114	NA	12.5	12.5	Pass
NVNT	n20	5700	Ant1	5765-26000	23369.45	-36.55	NA	0.2213	NA	2.5	2.5	Pass
NVNT	n40	5190	Ant1	30-5141.6	3756.36	-37.76	NA	0.1675	NA	2.5	2.5	Pass
NVNT	n40	5190	Ant1	5141.6-5150	5147.03	-31.79	NA	0.6622	NA	15	15	Pass
NVNT	n40	5190	Ant1	5250-5251	5250.98	-39.27	NA	0.1183	NA	500	50	Pass
NVNT	n40	5190	Ant1	5251-5270	5269.28	-39.72	NA	0.1067	NA	50	7.92	Pass
NVNT	n40	5190	Ant1	5270-5278.4	5278.24	-40.53	NA	0.0885	NA	7.92	2.48	Pass
NVNT	n40	5190	Ant1	5278.4-26000	25937.84	-37.25	NA	0.1884	NA	2.5	2.5	Pass
NVNT	n40	5200	Ant1	30-5141.6	3827.92	-38.53	NA	0.1403	NA	2.5	2.5	Pass
NVNT	n40	5200	Ant1	5141.6-5150	5148.67	-36.53	NA	0.2223	NA	15	15	Pass
NVNT	n40	5200	Ant1	5250-5251	5250.98	-38.89	NA	0.1291	NA	500	50	Pass
NVNT	n40	5200	Ant1	5251-5270	5269.81	-39.27	NA	0.1183	NA	50	7.92	Pass
NVNT	n40	5200	Ant1	5270-5278.4	5278.16	-40.03	NA	0.0993	NA	7.92	2.48	Pass
NVNT	n40	5200	Ant1	5278.4-26000	25564.85	-36.06	NA	0.2477	NA	2.5	2.5	Pass
NVNT	n40	5230	Ant1	30-5141.6	3776.80	-38.21	NA	0.151	NA	2.5	2.5	Pass
NVNT	n40	5230	Ant1	5141.6-5150	5142.37	-37.48	NA	0.1786	NA	15	15	Pass
NVNT	n40	5230	Ant1	5250-5251	5250.99	-28.51	NA	1.4093	NA	500	50	Pass
NVNT	n40	5230	Ant1	5251-5270	5262.84	-27.38	NA	1.8281	NA	50	7.92	Pass
NVNT	n40	5230	Ant1	5270-5278.4	5278.11	-39.04	NA	0.1247	NA	7.92	2.48	Pass
NVNT	n40	5230	Ant1	5278.4-26000	5278.40	-35.16	NA	0.3048	NA	2.5	2.5	Pass
NVNT	n40	5270	Ant1	30-5221.6	3757.57	-39.31	NA	0.1172	NA	2.5	2.5	Pass
NVNT	n40	5270	Ant1	5221.6-5230	5223.36	-39.42	NA	0.1143	NA	2.48	7.92	Pass
NVNT	n40	5270	Ant1	5230-5249	5232.87	-35.89	NA	0.2576	NA	7.92	50	Pass
NVNT	n40	5270	Ant1	5249-5250	5249.01	-37.08	NA	0.1959	NA	50	500	Pass
NVNT	n40	5270	Ant1	5350-5358.4	5354.04	-41.59	NA	0.0693	NA	15	15	Pass
NVNT	n40	5270	Ant1	5358.4-26000	24059.69	-38.41	NA	0.1442	NA	2.5	2.5	Pass
NVNT	n40	5310	Ant1	30-5221.6	3767.95	-39.63	NA	0.1089	NA	2.5	2.5	Pass
NVNT	n40	5310	Ant1	5221.6-5230	5222.30	-41.35	NA	0.0733	NA	2.48	7.92	Pass
NVNT	n40	5310	Ant1	5230-5249	5230.25	-41.87	NA	0.065	NA	7.92	50	Pass
NVNT	n40	5310	Ant1	5249-5250	5249.03	-42.32	NA	0.0586	NA	50	500	Pass
NVNT	n40	5310	Ant1	5350-5358.4	5350.88	-40.82	NA	0.0828	NA	15	15	Pass
NVNT	n40	5310	Ant1	5358.4-26000	25380.75	-38.55	NA	0.1396	NA	2.5	2.5	Pass
NVNT	n40	5510	Ant1	30-5460	3776.70	-38.03	NA	0.1574	NA	12.5	12.5	Pass
NVNT	n40	5510	Ant1	5460-5470	5464.99	-38.33	NA	0.1469	NA	50	50	Pass
NVNT	n40	5510	Ant1	5770-26000	25656.09	-36.48	NA	0.2249	NA	12.5	12.5	Pass
NVNT	n40	5590	Ant1	30-5460	3896.16	-37.69	NA	0.1702	NA	12.5	12.5	Pass
NVNT	n40	5590	Ant1	5460-5470	5465.30	-40.50	NA	0.0891	NA	50	50	Pass
NVNT	n40	5590	Ant1	5770-26000	24523.21	-36.79	NA	0.2094	NA	12.5	12.5	Pass

NVNT	n40	5670	Ant1	30-5460	3803.85	-36.22	NA	0.2388	NA	12.5	12.5	Pass
NVNT	n40	5670	Ant1	5460-5470	5462.34	-40.10	NA	0.0977	NA	50	50	Pass
NVNT	n40	5670	Ant1	5770-26000	24037.69	-37.32	NA	0.1854	NA	12.5	12.5	Pass
NVNT	ac20	5180	Ant1	30-5142	3802.66	-39.13	NA	0.1222	NA	2.5	2.5	Pass
NVNT	ac20	5180	Ant1	5142-5150	5149.73	-36.61	NA	0.2183	NA	15	15	Pass
NVNT	ac20	5180	Ant1	5250-5251	5250.97	-40.91	NA	0.0811	NA	1000	100	Pass
NVNT	ac20	5180	Ant1	5251-5260	5259.63	-41.21	NA	0.0757	NA	100	15.85	Pass
NVNT	ac20	5180	Ant1	5260-5266.7	5266.65	-41.25	NA	0.075	NA	15.85	2.49	Pass
NVNT	ac20	5180	Ant1	5266.7-26000	22599.74	-37.95	NA	0.1603	NA	2.5	2.5	Pass
NVNT	ac20	5200	Ant1	30-5142	3812.88	-38.27	NA	0.1489	NA	2.5	2.5	Pass
NVNT	ac20	5200	Ant1	5142-5150	5143.43	-39.14	NA	0.1219	NA	15	15	Pass
NVNT	ac20	5200	Ant1	5250-5251	5250.98	-39.76	NA	0.1057	NA	1000	100	Pass
NVNT	ac20	5200	Ant1	5251-5260	5259.96	-40.70	NA	0.0851	NA	100	15.85	Pass
NVNT	ac20	5200	Ant1	5260-5266.7	5266.29	-40.88	NA	0.0817	NA	15.85	2.49	Pass
NVNT	ac20	5200	Ant1	5266.7-26000	25854.87	-36.79	NA	0.2094	NA	2.5	2.5	Pass
NVNT	ac20	5240	Ant1	30-5142	3848.66	-38.44	NA	0.1432	NA	2.5	2.5	Pass
NVNT	ac20	5240	Ant1	5142-5150	5142.52	-37.93	NA	0.1611	NA	15	15	Pass
NVNT	ac20	5240	Ant1	5250-5251	5251.00	-11.13	-23.171	77.0903	4.8184	1000	100	Pass
NVNT	ac20	5240	Ant1	5251-5260	5251.02	-11.60	-23.305	69.1831	4.6720	100	15.85	Pass
NVNT	ac20	5240	Ant1	5260-5266.7	5266.64	-40.59	NA	0.0873	NA	15.85	2.49	Pass
NVNT	ac20	5240	Ant1	5266.7-26000	25668.27	-37.51	NA	0.1774	NA	2.5	2.5	Pass
NVNT	ac20	5260	Ant1	30-5233.3	3838.82	-40.70	NA	0.0851	NA	2.5	2.5	Pass
NVNT	ac20	5260	Ant1	5233.3-5240	5234.18	-40.08	NA	0.0982	NA	2.49	15.85	Pass
NVNT	ac20	5260	Ant1	5240-5249	5249.00	-12.66	-24.901	54.2001	3.2352	15.85	100	Pass
NVNT	ac20	5260	Ant1	5249-5250	5249.01	-12.95	NA	50.6991	NA	100	1000	Pass
NVNT	ac20	5260	Ant1	5350-26000	23935.00	-38.58	NA	0.1387	NA	2.5	2.5	Pass
NVNT	ac20	5300	Ant1	30-5233.3	3698.33	-40.29	NA	0.0935	NA	2.5	2.5	Pass
NVNT	ac20	5300	Ant1	5233.3-5240	5233.43	-42.55	NA	0.0556	NA	2.49	15.85	Pass
NVNT	ac20	5300	Ant1	5240-5249	5240.58	-41.88	NA	0.0649	NA	15.85	100	Pass
NVNT	ac20	5300	Ant1	5249-5250	5249.10	-40.98	NA	0.0798	NA	100	1000	Pass
NVNT	ac20	5300	Ant1	5350-26000	25669.60	-38.38	NA	0.1452	NA	2.5	2.5	Pass
NVNT	ac20	5320	Ant1	30-5233.3	3739.95	-38.32	NA	0.1472	NA	2.5	2.5	Pass
NVNT	ac20	5320	Ant1	5233.3-5240	5233.57	-41.02	NA	0.0791	NA	2.49	15.85	Pass
NVNT	ac20	5320	Ant1	5240-5249	5240.11	-41.66	NA	0.0682	NA	15.85	100	Pass
NVNT	ac20	5320	Ant1	5249-5250	5249.14	-41.52	NA	0.0705	NA	100	1000	Pass
NVNT	ac20	5320	Ant1	5350-26000	24162.15	-38.83	NA	0.1309	NA	2.5	2.5	Pass
NVNT	ac20	5500	Ant1	30-5460	3700.68	-37.54	NA	0.1762	NA	2.5	2.5	Pass
NVNT	ac20	5500	Ant1	5460-5470	5464.53	-39.85	NA	0.1035	NA	12.5	12.5	Pass
NVNT	ac20	5500	Ant1	5745-5765	5763.02	-39.75	NA	0.1059	NA	12.5	12.5	Pass
NVNT	ac20	5500	Ant1	5765-26000	25878.59	-37.06	NA	0.1968	NA	2.5	2.5	Pass
NVNT	ac20	5580	Ant1	30-5460	4352.28	-37.94	NA	0.1607	NA	2.5	2.5	Pass
NVNT	ac20	5580	Ant1	5460-5470	5460.65	-39.97	NA	0.1007	NA	12.5	12.5	Pass
NVNT	ac20	5580	Ant1	5745-5765	5756.66	-39.39	NA	0.1151	NA	12.5	12.5	Pass
NVNT	ac20	5580	Ant1	5765-26000	23996.74	-36.66	NA	0.2158	NA	2.5	2.5	Pass

NVNT	ac20	5700	Ant1	30-5460	3722.40	-38.26	NA	0.1493	NA	2.5	2.5	Pass
NVNT	ac20	5700	Ant1	5460-5470	5462.41	-40.63	NA	0.0865	NA	12.5	12.5	Pass
NVNT	ac20	5700	Ant1	5745-5765	5751.32	-39.43	NA	0.114	NA	12.5	12.5	Pass
NVNT	ac20	5700	Ant1	5765-26000	23996.74	-37.07	NA	0.1963	NA	2.5	2.5	Pass
NVNT	ac40	5190	Ant1	30-5141.6	5136.49	-34.02	NA	0.3963	NA	2.5	2.5	Pass
NVNT	ac40	5190	Ant1	5141.6-5150	5146.01	-29.33	NA	1.1668	NA	15	15	Pass
NVNT	ac40	5190	Ant1	5250-5251	5250.98	-35.61	NA	0.2748	NA	500	50	Pass
NVNT	ac40	5190	Ant1	5251-5270	5257.63	-33.96	NA	0.4018	NA	50	7.92	Pass
NVNT	ac40	5190	Ant1	5270-5278.4	5277.94	-38.76	NA	0.133	NA	7.92	2.48	Pass
NVNT	ac40	5190	Ant1	5278.4-26000	24093.61	-38.09	NA	0.1552	NA	2.5	2.5	Pass
NVNT	ac40	5200	Ant1	30-5141.6	5141.60	-37.86	NA	0.1637	NA	2.5	2.5	Pass
NVNT	ac40	5200	Ant1	5141.6-5150	5144.61	-32.51	NA	0.561	NA	15	15	Pass
NVNT	ac40	5200	Ant1	5250-5251	5250.94	-35.92	NA	0.2559	NA	500	50	Pass
NVNT	ac40	5200	Ant1	5251-5270	5267.32	-34.15	NA	0.3846	NA	50	7.92	Pass
NVNT	ac40	5200	Ant1	5270-5278.4	5277.61	-39.44	NA	0.1138	NA	7.92	2.48	Pass
NVNT	ac40	5200	Ant1	5278.4-26000	23969.28	-36.92	NA	0.2032	NA	2.5	2.5	Pass
NVNT	ac40	5230	Ant1	30-5141.6	3807.47	-38.88	NA	0.1294	NA	2.5	2.5	Pass
NVNT	ac40	5230	Ant1	5141.6-5150	5142.22	-37.91	NA	0.1618	NA	15	15	Pass
NVNT	ac40	5230	Ant1	5250-5251	5251.00	-19.32	NA	11.695	NA	500	50	Pass
NVNT	ac40	5230	Ant1	5251-5270	5251.04	-19.74	NA	10.617	NA	50	7.92	Pass
NVNT	ac40	5230	Ant1	5270-5278.4	5273.22	-32.20	NA	0.6026	NA	7.92	2.48	Pass
NVNT	ac40	5230	Ant1	5278.4-26000	5278.40	-32.16	NA	0.6081	NA	2.5	2.5	Pass
NVNT	ac40	5270	Ant1	30-5221.6	5216.41	-33.06	NA	0.4943	NA	2.5	2.5	Pass
NVNT	ac40	5270	Ant1	5221.6-5230	5224.88	-30.51	NA	0.8892	NA	2.48	7.92	Pass
NVNT	ac40	5270	Ant1	5230-5249	5242.90	-19.16	NA	12.1339	NA	7.92	50	Pass
NVNT	ac40	5270	Ant1	5249-5250	5249.00	-16.87	NA	20.5589	NA	50	500	Pass
NVNT	ac40	5270	Ant1	5350-5358.4	5351.90	-39.83	NA	0.104	NA	15	15	Pass
NVNT	ac40	5270	Ant1	5358.4-26000	24658.30	-38.63	NA	0.1371	NA	2.5	2.5	Pass
NVNT	ac40	5310	Ant1	30-5221.6	5019.13	-39.02	NA	0.1253	NA	2.5	2.5	Pass
NVNT	ac40	5310	Ant1	5221.6-5230	5223.48	-38.43	NA	0.1435	NA	2.48	7.92	Pass
NVNT	ac40	5310	Ant1	5230-5249	5230.19	-40.98	NA	0.0798	NA	7.92	50	Pass
NVNT	ac40	5310	Ant1	5249-5250	5249.08	-38.69	NA	0.1352	NA	50	500	Pass
NVNT	ac40	5310	Ant1	5350-5358.4	5350.69	-26.60	NA	2.1878	NA	15	15	Pass
NVNT	ac40	5310	Ant1	5358.4-26000	5358.40	-27.54	-52.718	1.762	0.0053	2.5	2.5	Pass
NVNT	ac40	5510	Ant1	30-5460	3847.29	-37.19	NA	0.191	NA	12.5	12.5	Pass
NVNT	ac40	5510	Ant1	5460-5470	5464.54	-39.50	NA	0.1122	NA	50	50	Pass
NVNT	ac40	5510	Ant1	5770-26000	22904.81	-37.47	NA	0.1791	NA	12.5	12.5	Pass
NVNT	ac40	5590	Ant1	30-5460	3858.15	-38.00	NA	0.1585	NA	12.5	12.5	Pass
NVNT	ac40	5590	Ant1	5460-5470	5465.43	-40.38	NA	0.0916	NA	50	50	Pass
NVNT	ac40	5590	Ant1	5770-26000	23612.86	-37.41	NA	0.1816	NA	12.5	12.5	Pass
NVNT	ac40	5670	Ant1	30-5460	3657.24	-38.18	NA	0.1521	NA	12.5	12.5	Pass
NVNT	ac40	5670	Ant1	5460-5470	5466.36	-40.48	NA	0.0895	NA	50	50	Pass
NVNT	ac40	5670	Ant1	5770-26000	25069.42	-36.96	NA	0.2014	NA	12.5	12.5	Pass
NVNT	ax20	5180	Ant1	30-5142	3777.10	-37.90	NA	0.1622	NA	2.5	2.5	Pass


NVNT	ax20	5180	Ant1	5142-5150	5149.13	-38.07	NA	0.156	NA	15	15	Pass
NVNT	ax20	5180	Ant1	5250-5250.2	5250.17	-40.26	NA	0.0942	NA	2154.43	630.96	Pass
NVNT	ax20	5180	Ant1	5250.2-5251	5250.98	-41.23	NA	0.0753	NA	630.96	100	Pass
NVNT	ax20	5180	Ant1	5251-5260	5259.51	-41.08	NA	0.078	NA	100	15.85	Pass
NVNT	ax20	5180	Ant1	5260-5266.7	5266.69	-41.04	NA	0.0787	NA	15.85	2.49	Pass
NVNT	ax20	5180	Ant1	5266.7-26000	24507.20	-37.23	NA	0.1892	NA	2.5	2.5	Pass
NVNT	ax20	5200	Ant1	30-5142	3858.89	-37.69	NA	0.1702	NA	2.5	2.5	Pass
NVNT	ax20	5200	Ant1	5142-5150	5146.46	-37.88	NA	0.1629	NA	15	15	Pass
NVNT	ax20	5200	Ant1	5250-5250.2	5250.19	-41.06	NA	0.0783	NA	2154.43	630.96	Pass
NVNT	ax20	5200	Ant1	5250.2-5251	5250.99	-41.39	NA	0.0726	NA	630.96	100	Pass
NVNT	ax20	5200	Ant1	5251-5260	5259.57	-41.13	NA	0.0771	NA	100	15.85	Pass
NVNT	ax20	5200	Ant1	5260-5266.7	5266.45	-41.50	NA	0.0708	NA	15.85	2.49	Pass
NVNT	ax20	5200	Ant1	5266.7-26000	25689.00	-36.51	NA	0.2234	NA	2.5	2.5	Pass
NVNT	ax20	5240	Ant1	30-5142	3782.21	-38.15	NA	0.1531	NA	2.5	2.5	Pass
NVNT	ax20	5240	Ant1	5142-5150	5146.50	-37.79	NA	0.1663	NA	15	15	Pass
NVNT	ax20	5240	Ant1	5250-5250.2	5250.20	-6.86	NA	206.063	NA	2154.43	630.96	Pass
NVNT	ax20	5240	Ant1	5250.2-5251	5251.00	-13.57	NA	43.9542	NA	630.96	100	Pass
NVNT	ax20	5240	Ant1	5251-5260	5251.01	-14.00	NA	39.8107	NA	100	15.85	Pass
NVNT	ax20	5240	Ant1	5260-5266.7	5266.20	-30.58	NA	0.875	NA	15.85	2.49	Pass
NVNT	ax20	5240	Ant1	5266.7-26000	25543.87	-36.33	NA	0.2328	NA	2.5	2.5	Pass
NVNT	ax20	5260	Ant1	30-5233.3	3781.58	-40.10	NA	0.0977	NA	2.5	2.5	Pass
NVNT	ax20	5260	Ant1	5233.3-5240	5239.35	-29.88	NA	1.028	NA	2.49	15.85	Pass
NVNT	ax20	5260	Ant1	5240-5249	5249.00	-10.71	-28.820	84.918	1.3122	15.85	100	Pass
NVNT	ax20	5260	Ant1	5249-5249.8	5249.40	-6.50	-21.596	223.8721	6.9247	100	630.96	Pass
NVNT	ax20	5260	Ant1	5249.8-5250	5249.80	-3.49	-13.823	447.7133	41.4668	630.96	2154.43	Pass
NVNT	ax20	5260	Ant1	5350-26000	25814.15	-38.26	NA	0.1493	NA	2.5	2.5	Pass
NVNT	ax20	5300	Ant1	30-5233.3	3755.56	-40.42	NA	0.0908	NA	2.5	2.5	Pass
NVNT	ax20	5300	Ant1	5233.3-5240	5233.45	-41.50	NA	0.0708	NA	2.49	15.85	Pass
NVNT	ax20	5300	Ant1	5240-5249	5240.10	-41.74	NA	0.067	NA	15.85	100	Pass
NVNT	ax20	5300	Ant1	5249-5249.8	5249.03	-42.08	NA	0.0619	NA	100	630.96	Pass
NVNT	ax20	5300	Ant1	5249.8-5250	5249.81	-41.48	NA	0.0711	NA	630.96	2154.43	Pass
NVNT	ax20	5300	Ant1	5350-26000	22778.60	-38.70	NA	0.1349	NA	2.5	2.5	Pass
NVNT	ax20	5320	Ant1	30-5233.3	3844.02	-39.81	NA	0.1045	NA	2.5	2.5	Pass
NVNT	ax20	5320	Ant1	5233.3-5240	5233.58	-41.98	NA	0.0634	NA	2.49	15.85	Pass
NVNT	ax20	5320	Ant1	5240-5249	5240.26	-40.98	NA	0.0798	NA	15.85	100	Pass
NVNT	ax20	5320	Ant1	5249-5249.8	5249.09	-40.91	NA	0.0811	NA	100	630.96	Pass
NVNT	ax20	5320	Ant1	5249.8-5250	5249.81	-40.82	NA	0.0828	NA	630.96	2154.43	Pass
NVNT	ax20	5320	Ant1	5350-26000	23790.45	-37.09	NA	0.1954	NA	2.5	2.5	Pass
NVNT	ax20	5500	Ant1	30-5460	3765.84	-37.97	NA	0.1596	NA	2.5	2.5	Pass
NVNT	ax20	5500	Ant1	5460-5470	5463.96	-39.35	NA	0.1161	NA	12.5	12.5	Pass
NVNT	ax20	5500	Ant1	5745-5765	5755.90	-39.52	NA	0.1117	NA	12.5	12.5	Pass
NVNT	ax20	5500	Ant1	5765-26000	24138.38	-36.28	NA	0.2355	NA	2.5	2.5	Pass
NVNT	ax20	5580	Ant1	30-5460	5101.62	-38.25	NA	0.1496	NA	2.5	2.5	Pass
NVNT	ax20	5580	Ant1	5460-5470	5465.24	-40.88	NA	0.0817	NA	12.5	12.5	Pass

NVNT	ax20	5580	Ant1	5745-5765	5758.12	-39.16	NA	0.1213	NA	12.5	12.5	Pass
NVNT	ax20	5580	Ant1	5765-26000	25635.77	-35.26	NA	0.2979	NA	2.5	2.5	Pass
NVNT	ax20	5700	Ant1	30-5460	3825.57	-37.23	NA	0.1892	NA	2.5	2.5	Pass
NVNT	ax20	5700	Ant1	5460-5470	5469.72	-40.04	NA	0.0991	NA	12.5	12.5	Pass
NVNT	ax20	5700	Ant1	5745-5765	5755.12	-39.07	NA	0.1239	NA	12.5	12.5	Pass
NVNT	ax20	5700	Ant1	5765-26000	25069.19	-35.78	NA	0.2642	NA	2.5	2.5	Pass
NVNT	ax40	5190	Ant1	30-5141.6	5141.60	-36.00	NA	0.2512	NA	2.5	2.5	Pass
NVNT	ax40	5190	Ant1	5141.6-5150	5149.69	-28.60	NA	1.3804	NA	15	15	Pass
NVNT	ax40	5190	Ant1	5250-5251	5250.93	-37.36	NA	0.1837	NA	500	50	Pass
NVNT	ax40	5190	Ant1	5251-5270	5269.11	-39.16	NA	0.1213	NA	50	7.92	Pass
NVNT	ax40	5190	Ant1	5270-5278.4	5278.40	-40.87	NA	0.0818	NA	7.92	2.48	Pass
NVNT	ax40	5190	Ant1	5278.4-26000	25792.78	-37.58	NA	0.1746	NA	2.5	2.5	Pass
NVNT	ax40	5200	Ant1	30-5141.6	5141.60	-36.92	NA	0.2032	NA	2.5	2.5	Pass
NVNT	ax40	5200	Ant1	5141.6-5150	5149.40	-32.63	NA	0.5458	NA	15	15	Pass
NVNT	ax40	5200	Ant1	5250-5251	5250.98	-36.27	NA	0.236	NA	500	50	Pass
NVNT	ax40	5200	Ant1	5251-5270	5267.34	-37.84	NA	0.1644	NA	50	7.92	Pass
NVNT	ax40	5200	Ant1	5270-5278.4	5277.95	-39.11	NA	0.1227	NA	7.92	2.48	Pass
NVNT	ax40	5200	Ant1	5278.4-26000	22912.48	-37.38	NA	0.1828	NA	2.5	2.5	Pass
NVNT	ax40	5230	Ant1	30-5141.6	4482.20	-38.58	NA	0.1387	NA	2.5	2.5	Pass
NVNT	ax40	5230	Ant1	5141.6-5150	5144.48	-37.31	NA	0.1858	NA	15	15	Pass
NVNT	ax40	5230	Ant1	5250-5251	5251.00	-19.21	NA	11.995	NA	500	50	Pass
NVNT	ax40	5230	Ant1	5251-5270	5263.05	-23.32	NA	4.6559	NA	50	7.92	Pass
NVNT	ax40	5230	Ant1	5270-5278.4	5277.08	-33.09	NA	0.4909	NA	7.92	2.48	Pass
NVNT	ax40	5230	Ant1	5278.4-26000	5278.40	-33.46	NA	0.4508	NA	2.5	2.5	Pass
NVNT	ax40	5270	Ant1	30-5221.6	5221.60	-36.72	NA	0.2128	NA	2.5	2.5	Pass
NVNT	ax40	5270	Ant1	5221.6-5230	5226.70	-29.75	NA	1.0593	NA	2.48	7.92	Pass
NVNT	ax40	5270	Ant1	5230-5249	5243.51	-19.70	NA	10.7152	NA	7.92	50	Pass
NVNT	ax40	5270	Ant1	5249-5250	5249.00	-19.37	NA	11.5611	NA	50	500	Pass
NVNT	ax40	5270	Ant1	5350-5358.4	5353.18	-39.26	NA	0.1186	NA	15	15	Pass
NVNT	ax40	5270	Ant1	5358.4-26000	25091.77	-40.49	NA	0.0893	NA	2.5	2.5	Pass
NVNT	ax40	5310	Ant1	30-5221.6	3752.38	-39.53	NA	0.1114	NA	2.5	2.5	Pass
NVNT	ax40	5310	Ant1	5221.6-5230	5221.76	-41.21	NA	0.0757	NA	2.48	7.92	Pass
NVNT	ax40	5310	Ant1	5230-5249	5232.91	-39.49	NA	0.1125	NA	7.92	50	Pass
NVNT	ax40	5310	Ant1	5249-5250	5249.06	-39.18	NA	0.1208	NA	50	500	Pass
NVNT	ax40	5310	Ant1	5350-5358.4	5350.53	-30.83	NA	0.826	NA	15	15	Pass
NVNT	ax40	5310	Ant1	5358.4-26000	5358.40	-31.02	NA	0.7907	NA	2.5	2.5	Pass
NVNT	ax40	5510	Ant1	30-5460	3950.46	-37.65	NA	0.1718	NA	12.5	12.5	Pass
NVNT	ax40	5510	Ant1	5460-5470	5469.55	-38.74	NA	0.1337	NA	50	50	Pass
NVNT	ax40	5510	Ant1	5770-26000	25777.47	-36.88	NA	0.2051	NA	12.5	12.5	Pass
NVNT	ax40	5590	Ant1	30-5460	3890.73	-38.53	NA	0.1403	NA	12.5	12.5	Pass
NVNT	ax40	5590	Ant1	5460-5470	5460.09	-40.90	NA	0.0813	NA	50	50	Pass
NVNT	ax40	5590	Ant1	5770-26000	25514.48	-36.85	NA	0.2065	NA	12.5	12.5	Pass
NVNT	ax40	5670	Ant1	30-5460	3907.02	-38.60	NA	0.138	NA	12.5	12.5	Pass
NVNT	ax40	5670	Ant1	5460-5470	5467.58	-39.65	NA	0.1084	NA	50	50	Pass


NVNT	ax40	5670	Ant1	5770-26000	24948.04	-36.41	NA	0.2286	NA	12.5	12.5	Pass

Test Graphs


Tx. Spurious NVNT a 5180MHz Ant1 @ 30MHz-5142MHz

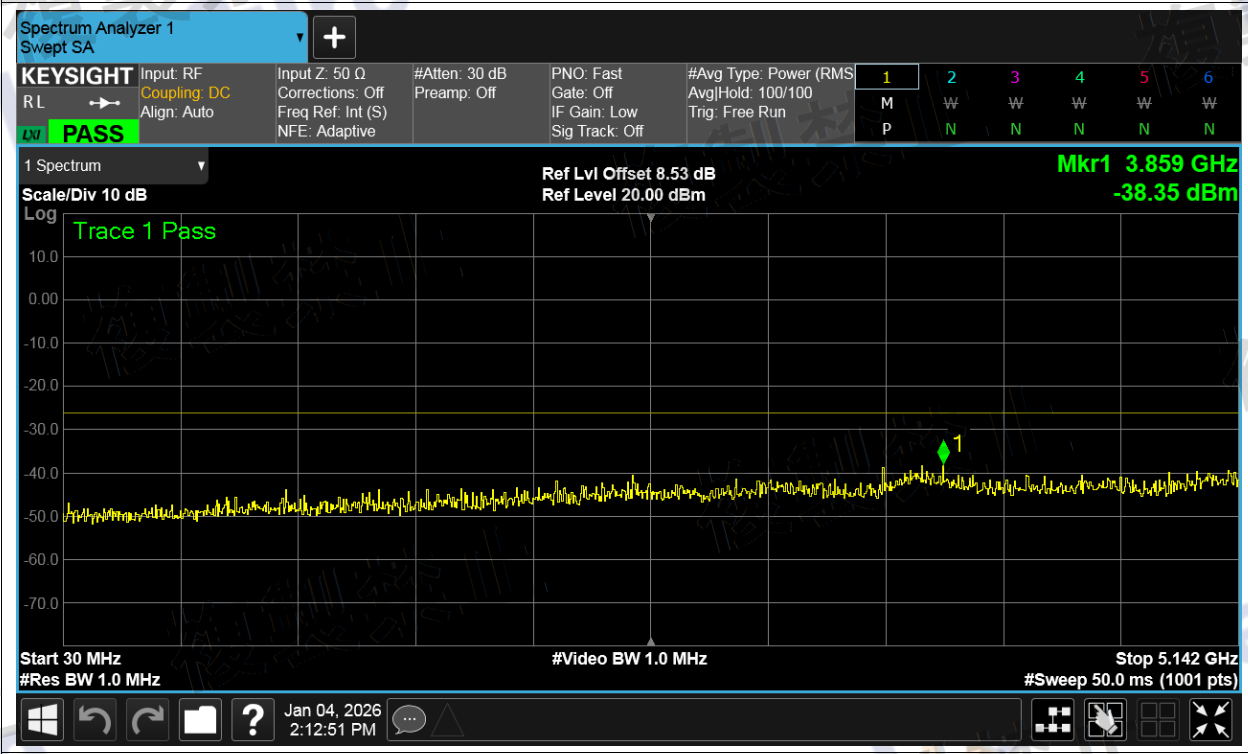


Tx. Spurious NVNT a 5180MHz Ant1 @ 5142MHz-5150MHz

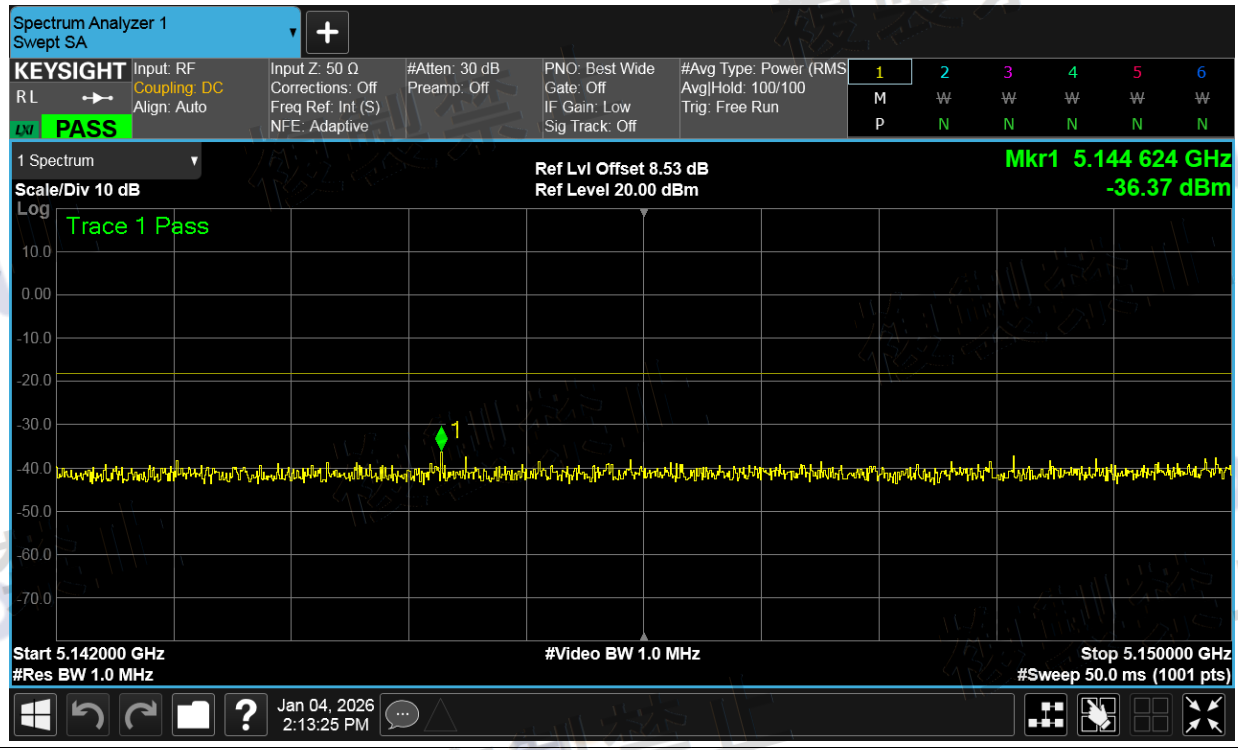


Tx. Spurious NVNT a 5180MHz Ant1 @ 5250MHz-5251MHz

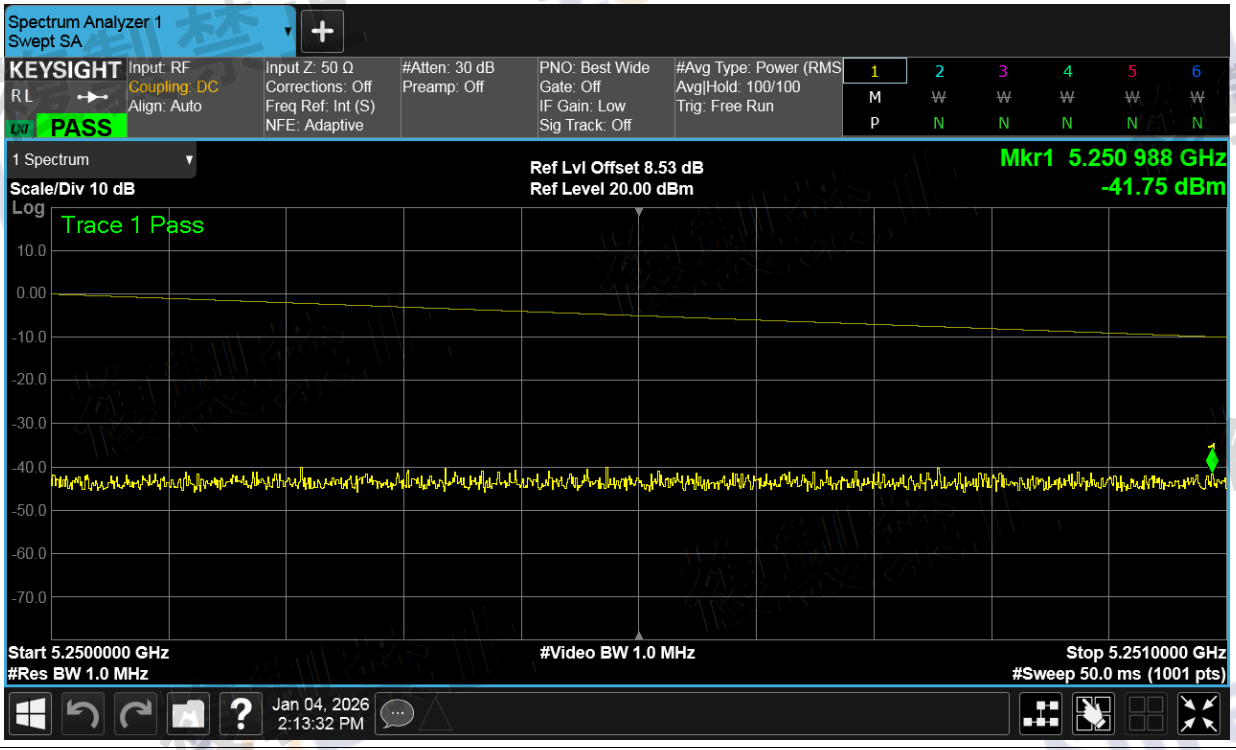


Tx. Spurious NVNT a 5180MHz Ant1 @ 5251MHz-5260MHz

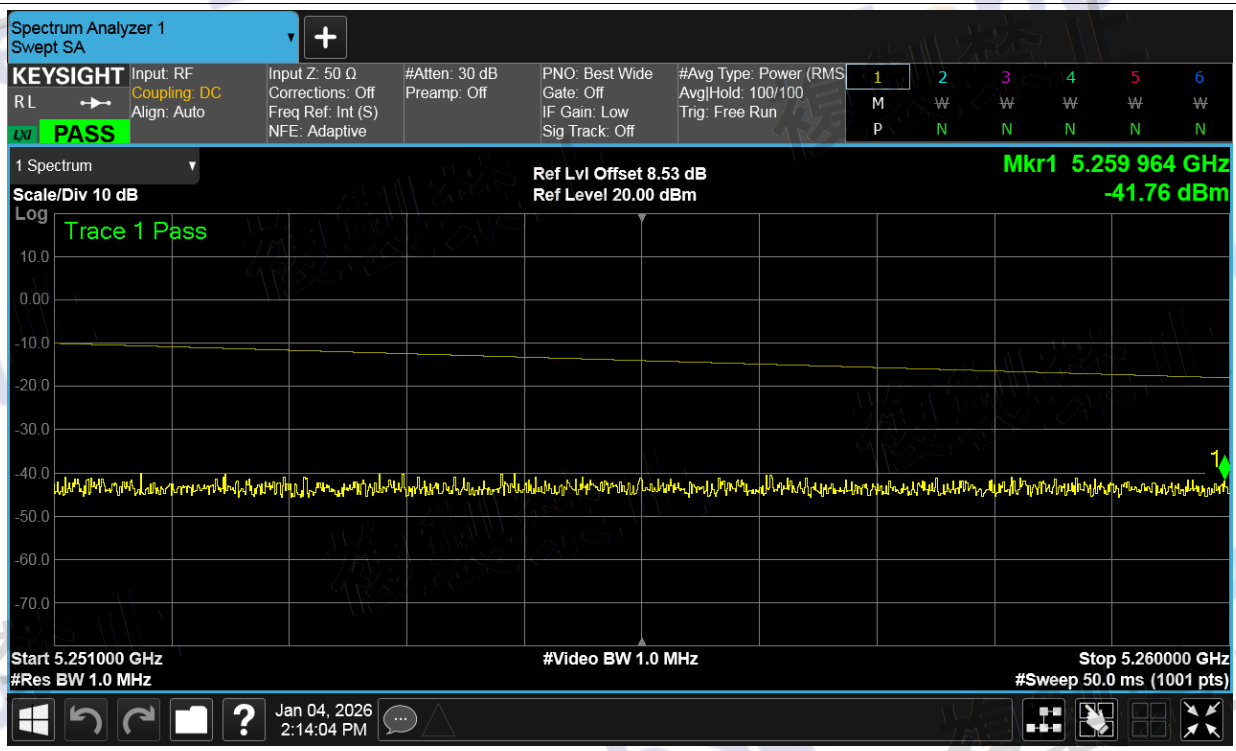


Tx. Spurious NVNT a 5180MHz Ant1 @ 5260MHz-5266.7MHz

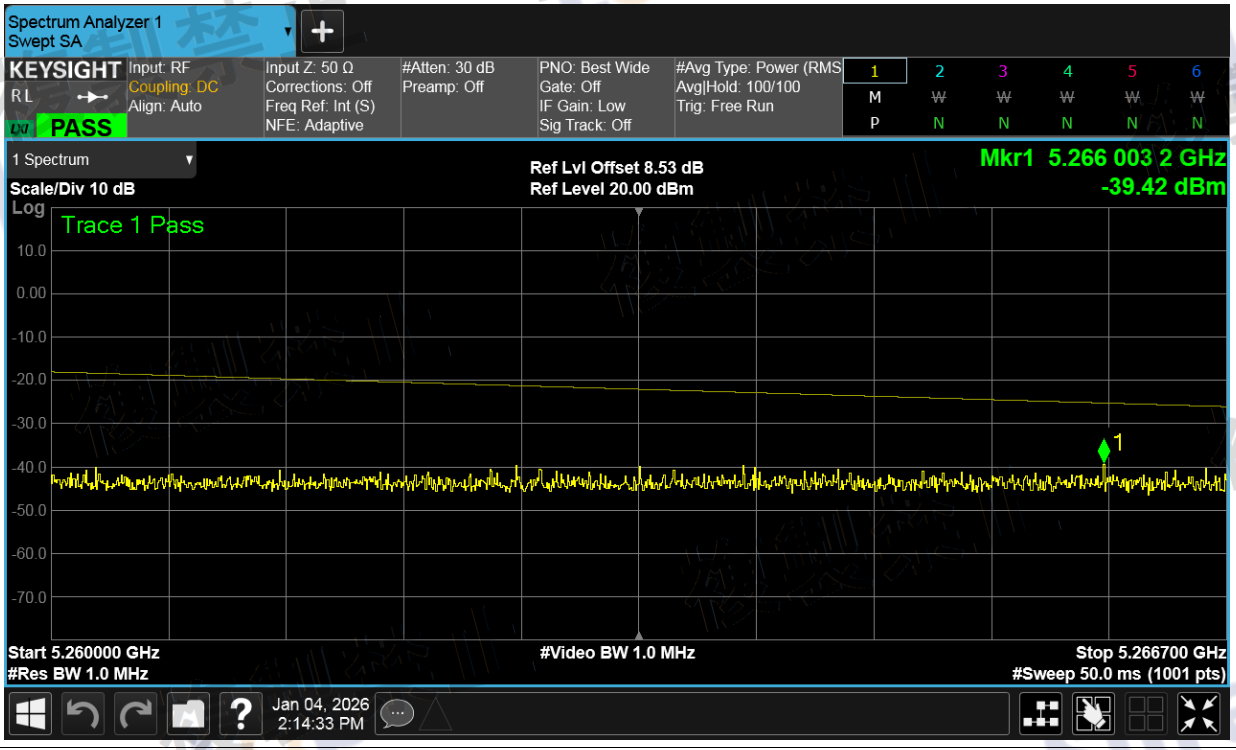


Tx. Spurious NVNT a 5180MHz Ant1 @ 5266.7MHz-26000MHz

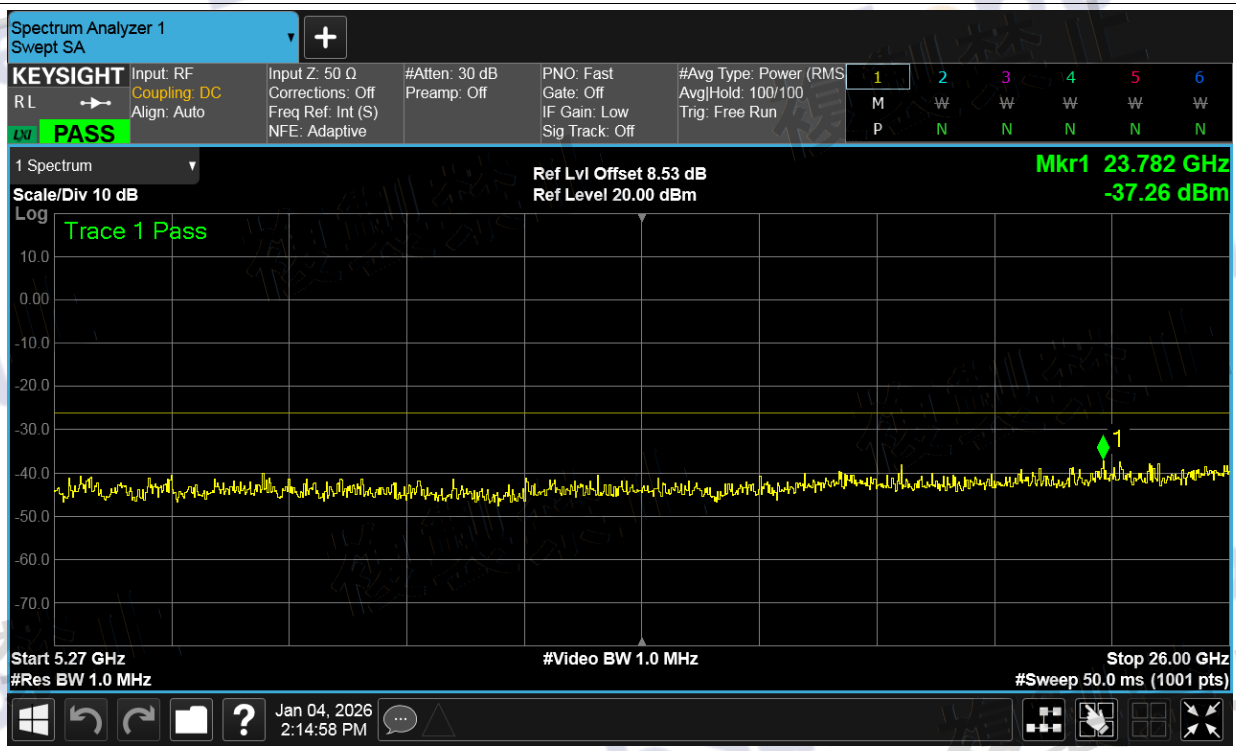


Tx. Spurious NVNT a 5200MHz Ant1 @ 30MHz-5142MHz

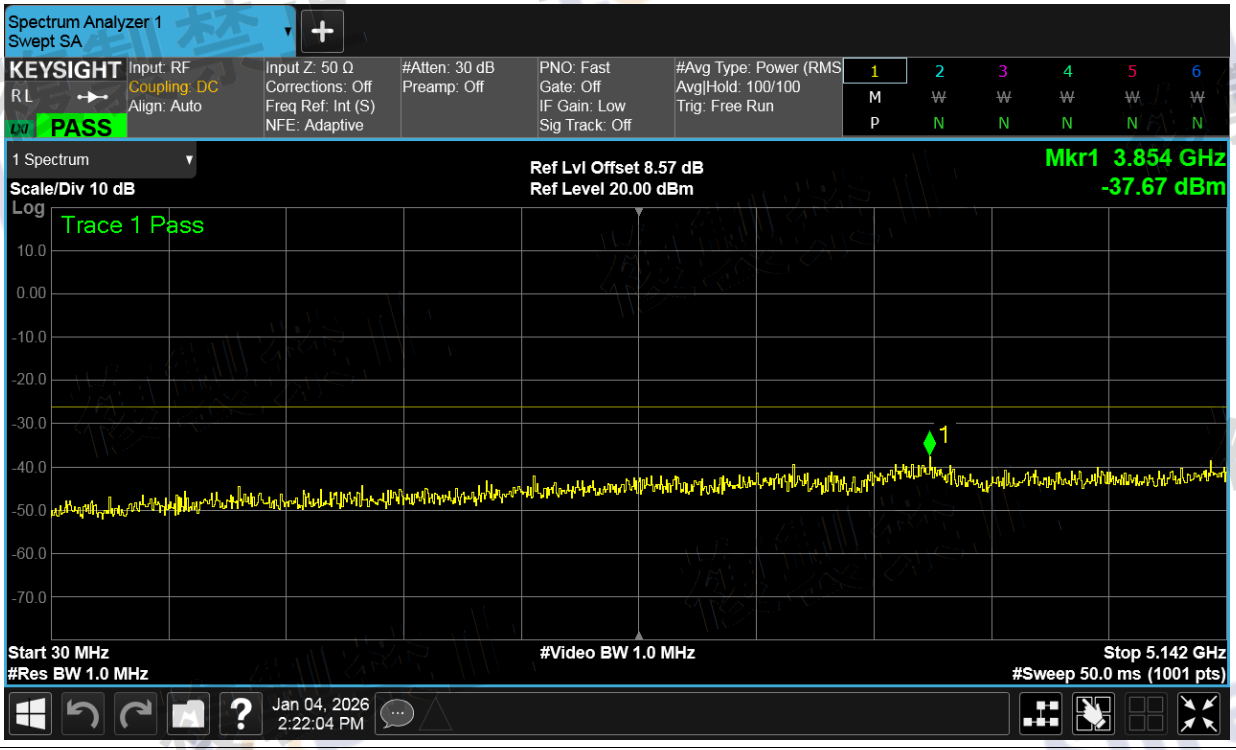


Tx. Spurious NVNT a 5200MHz Ant1 @ 5142MHz-5150MHz

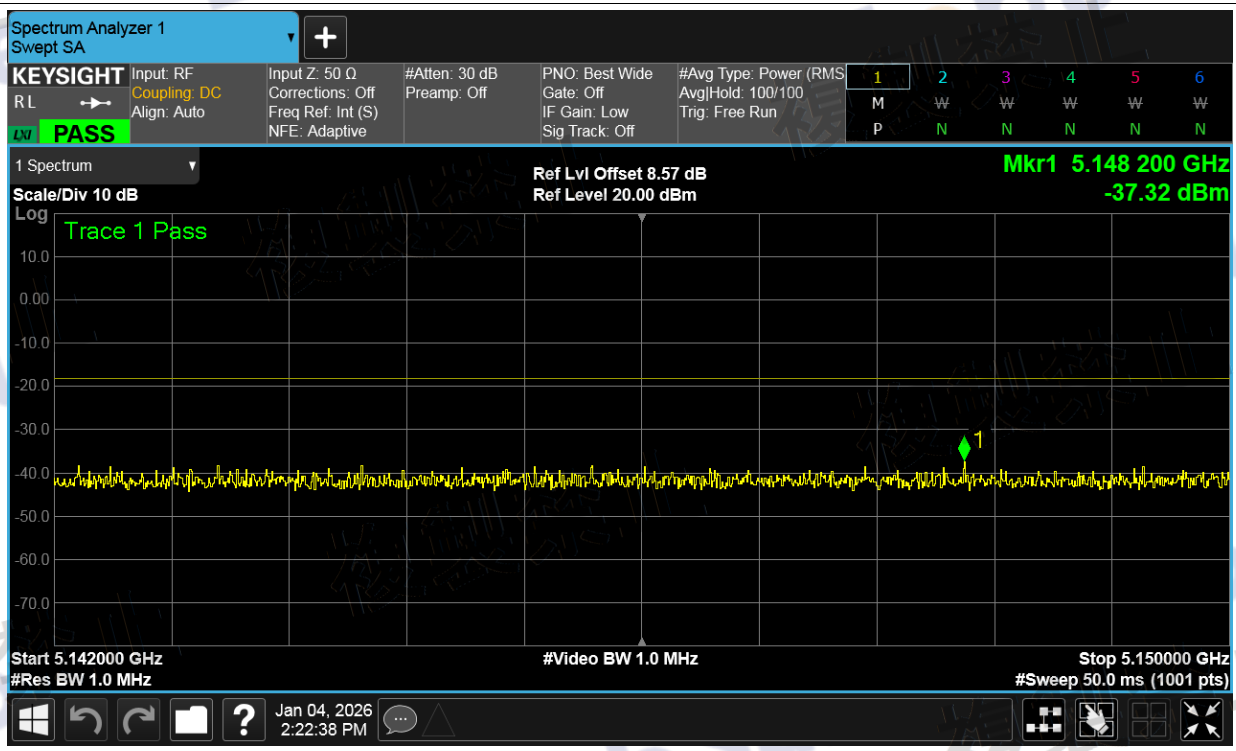


Tx. Spurious NVNT a 5200MHz Ant1 @ 5250MHz-5251MHz

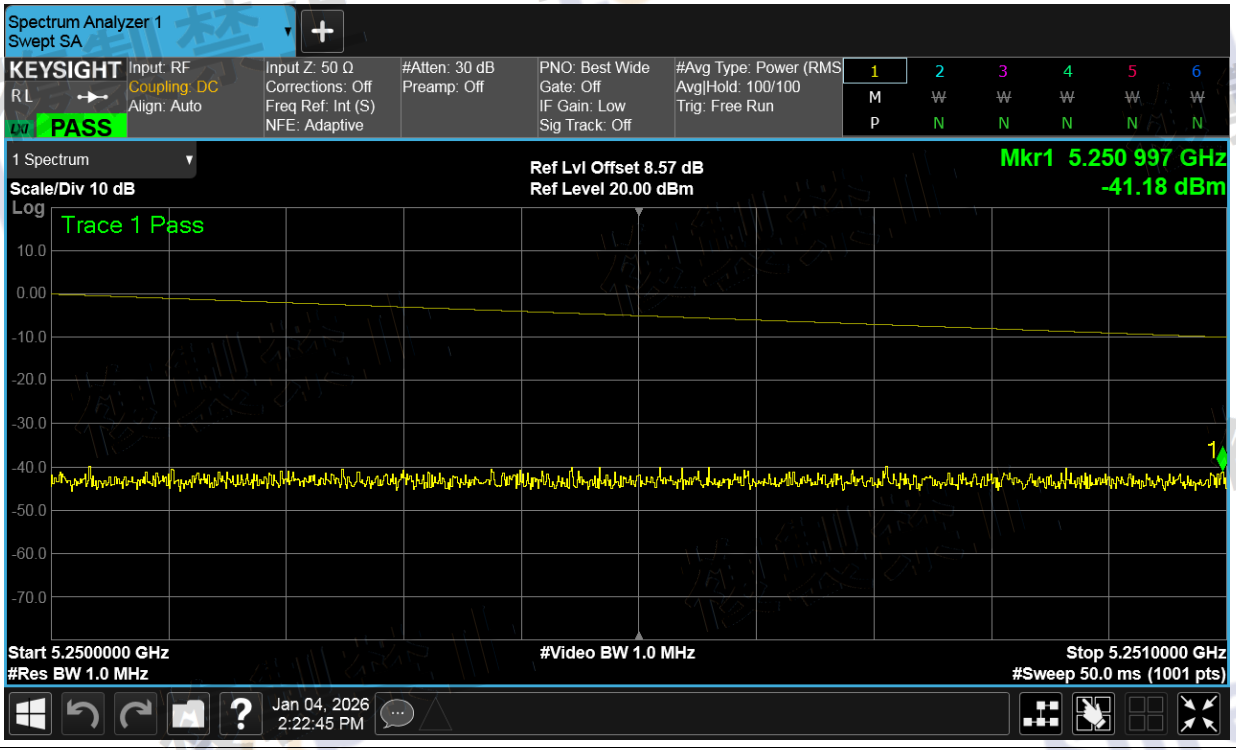


Tx. Spurious NVNT a 5200MHz Ant1 @ 5251MHz-5260MHz

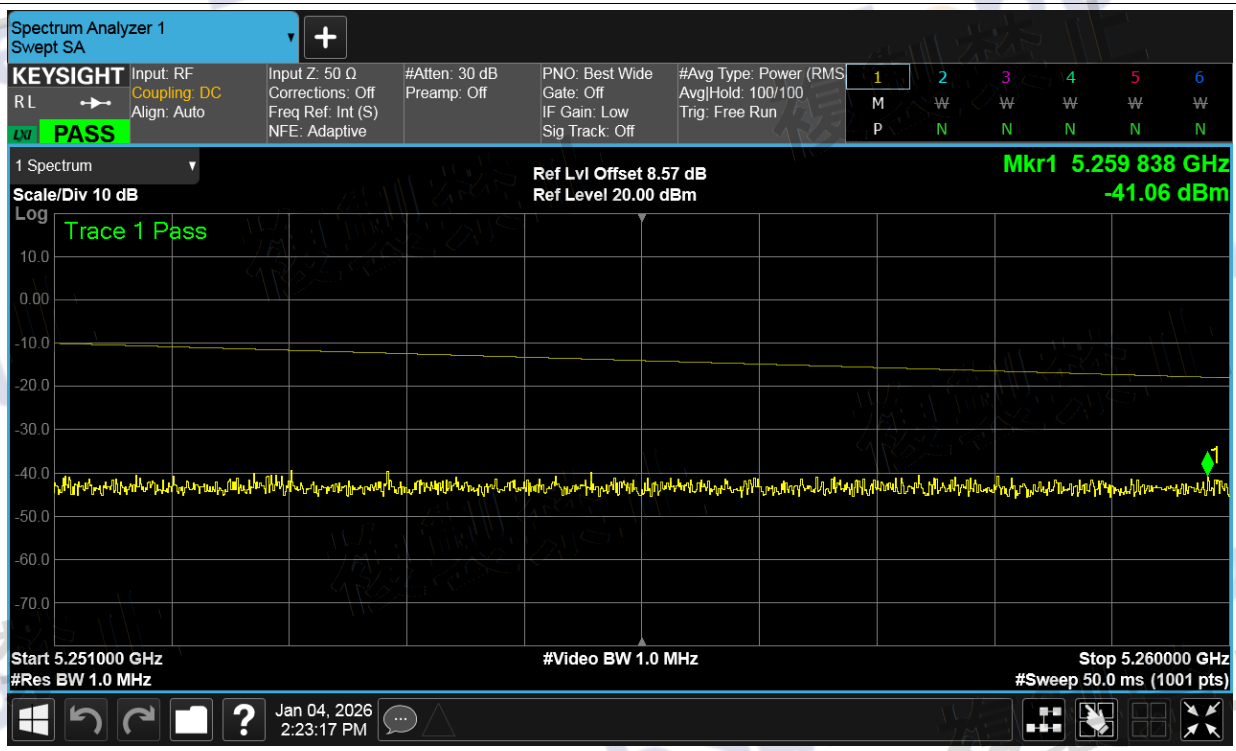


Tx. Spurious NVNT a 5200MHz Ant1 @ 5260MHz-5266.7MHz

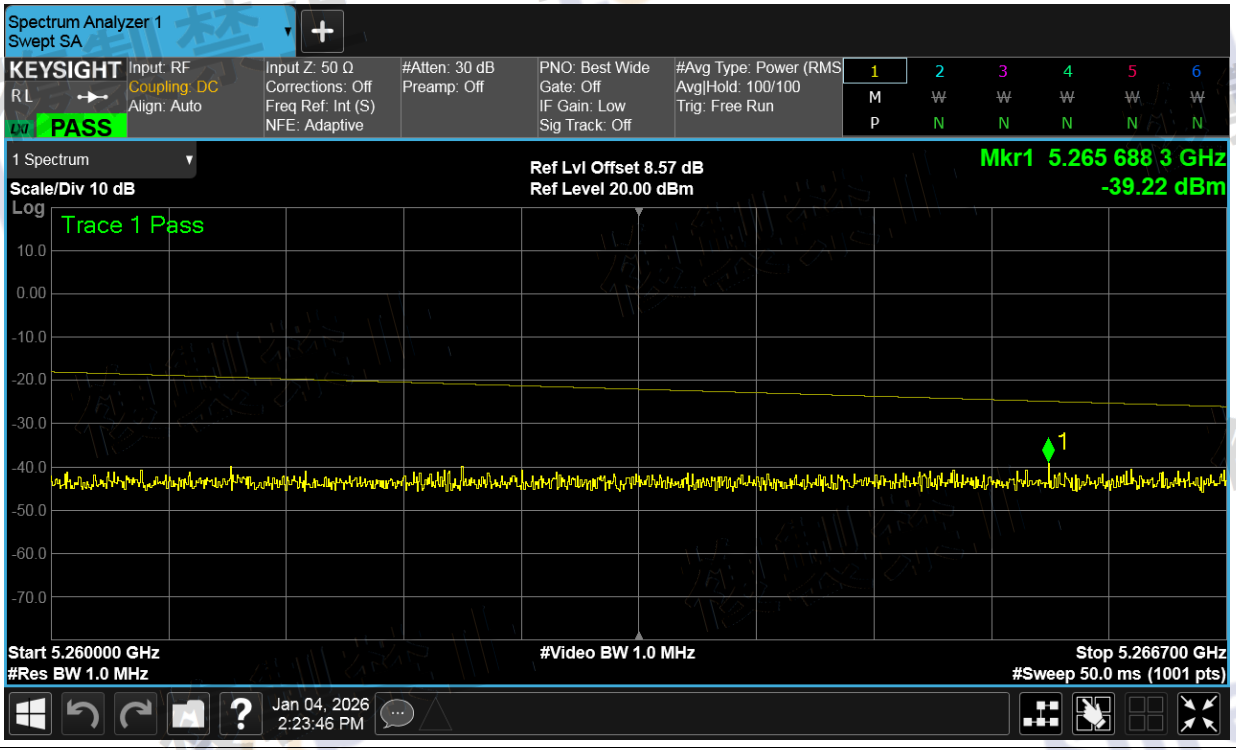


Tx. Spurious NVNT a 5200MHz Ant1 @ 5266.7MHz-26000MHz

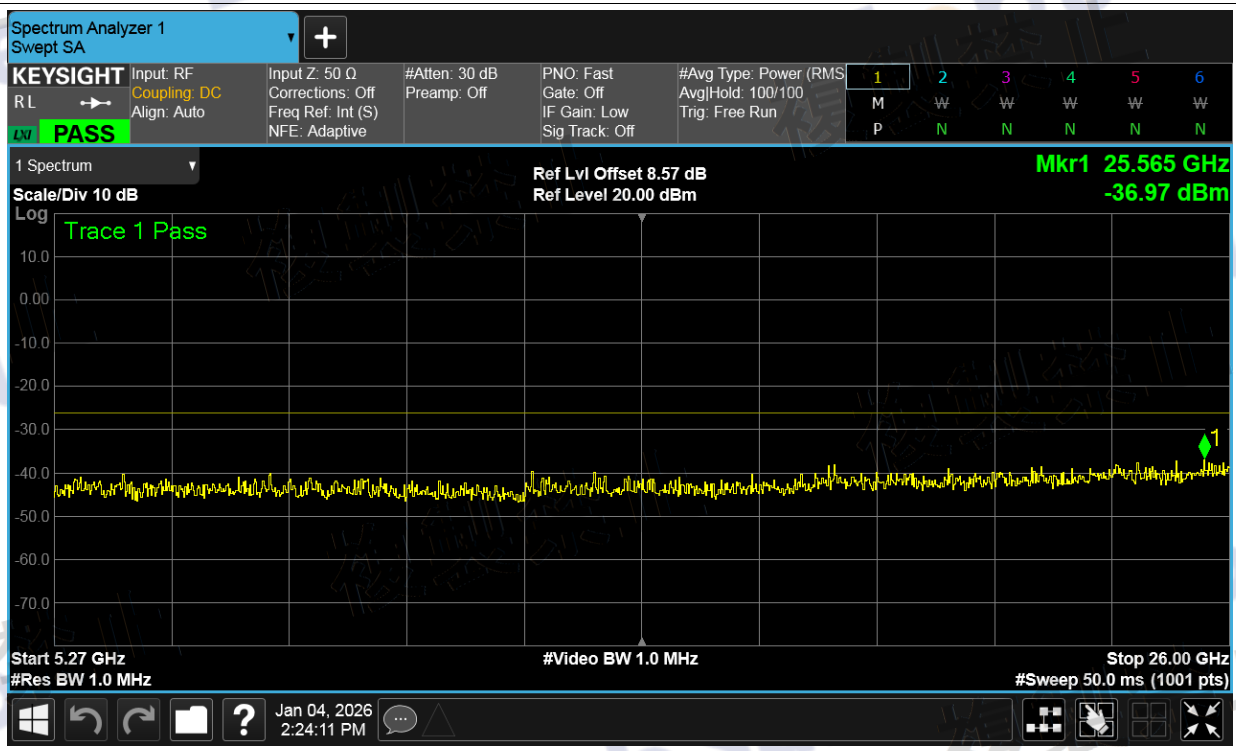


Tx. Spurious NVNT a 5240MHz Ant1 @ 30MHz-5142MHz

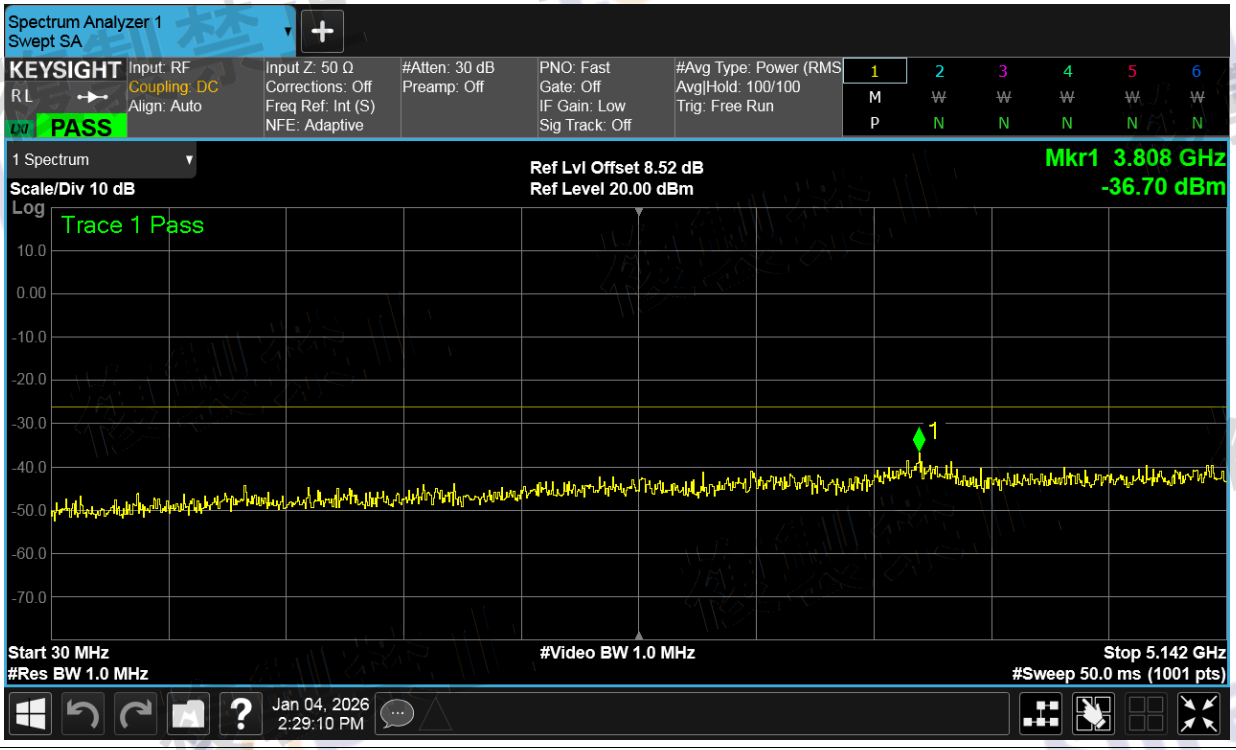


Tx. Spurious NVNT a 5240MHz Ant1 @ 5142MHz-5150MHz

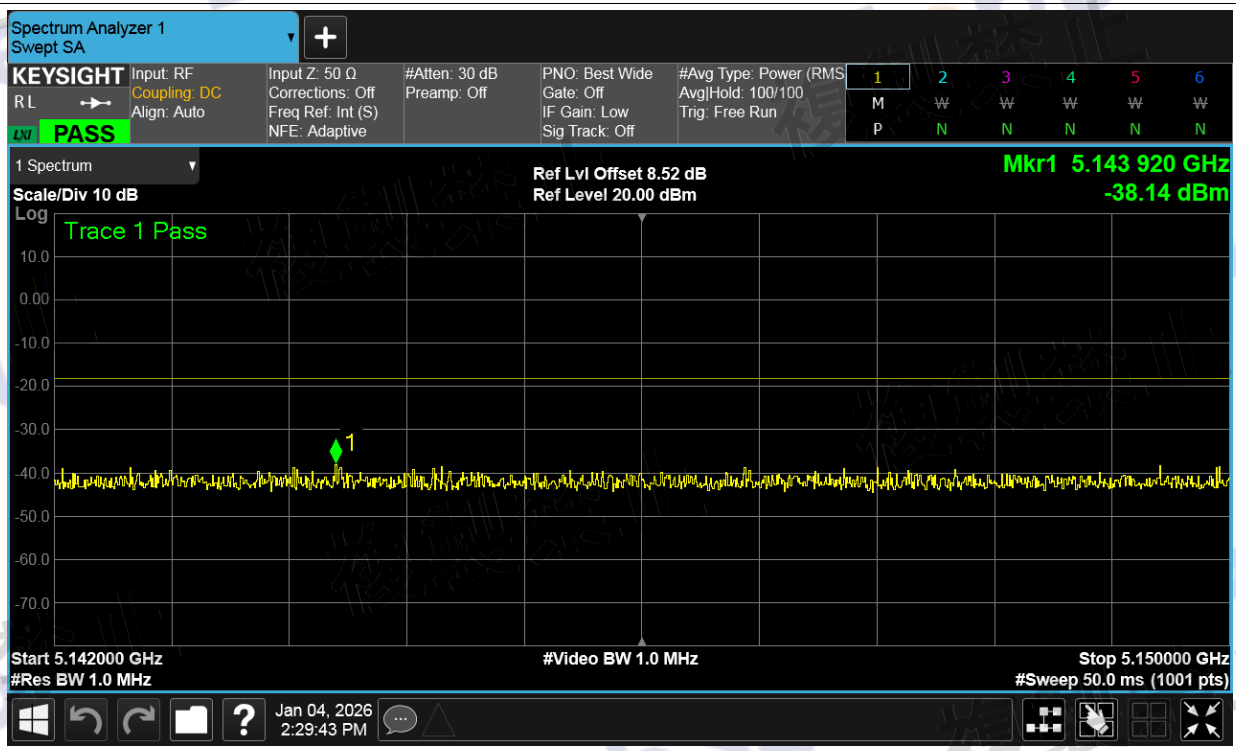


Tx. Spurious NVNT a 5240MHz Ant1 @ 5250MHz-5251MHz

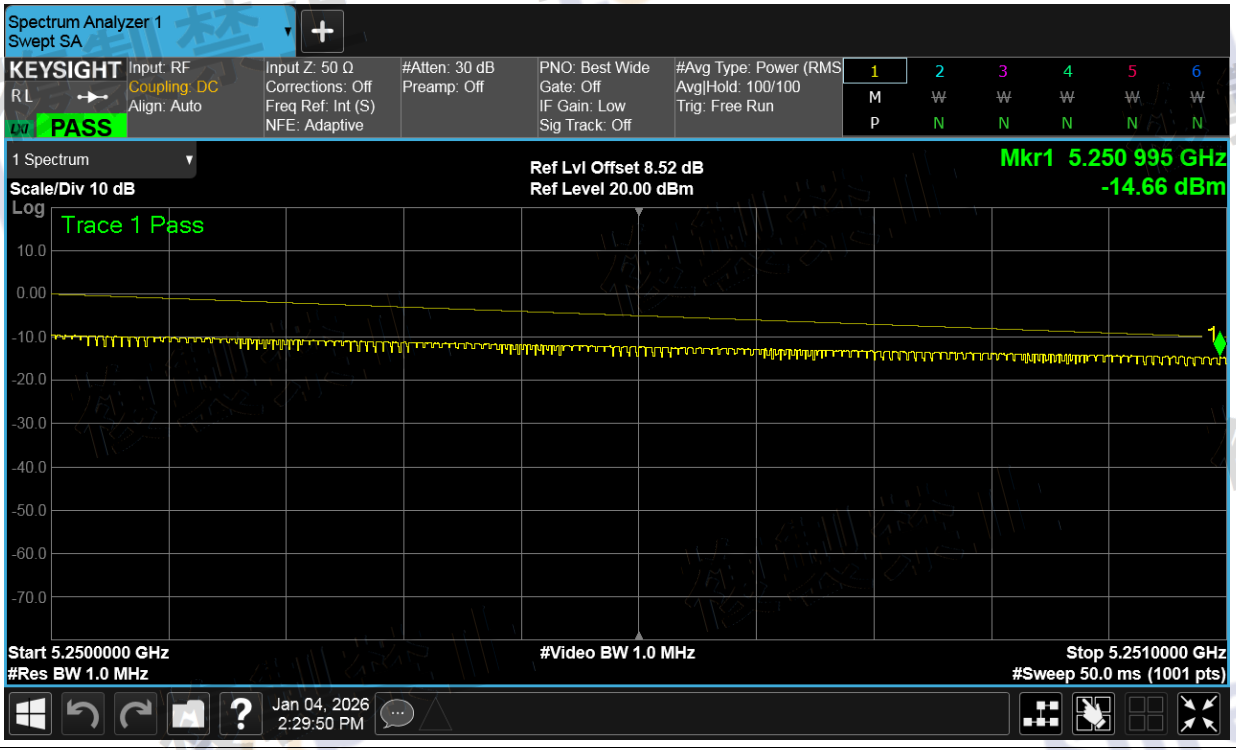


Tx. Spurious NVNT a 5240MHz Ant1 @ 5251MHz-5260MHz

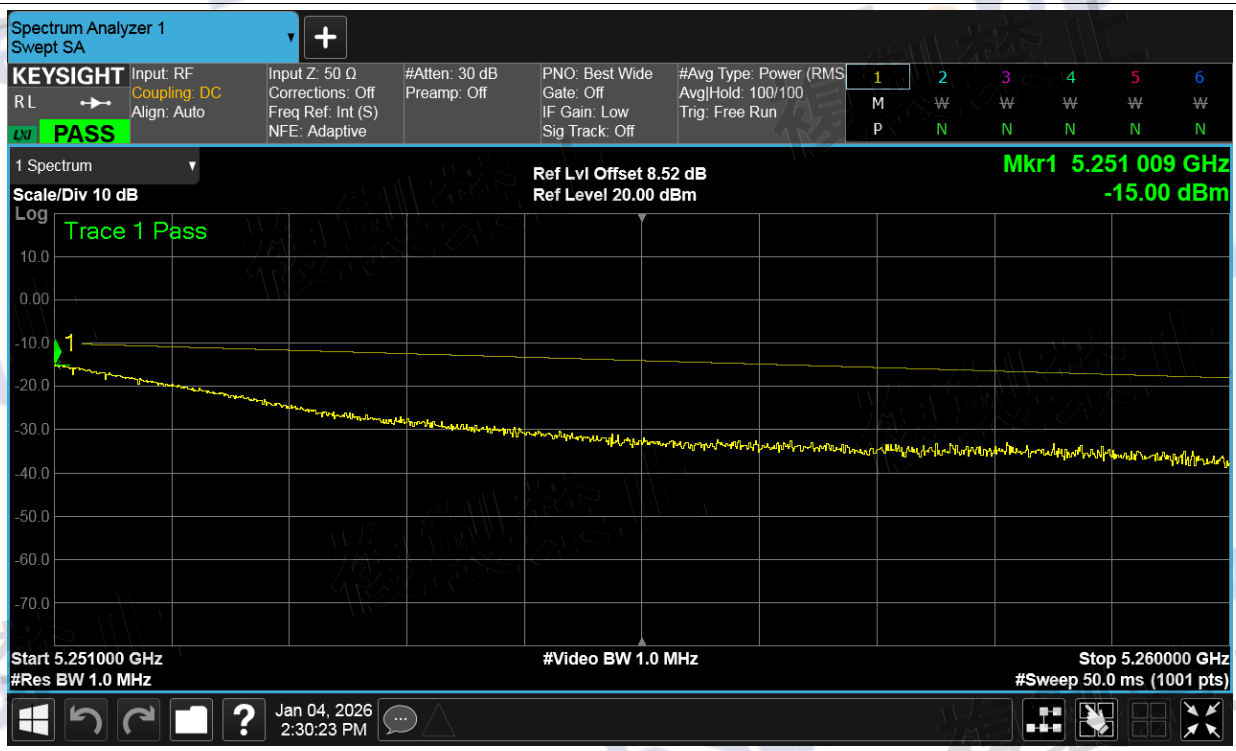


Tx. Spurious NVNT a 5240MHz Ant1 @ 5260MHz-5266.7MHz

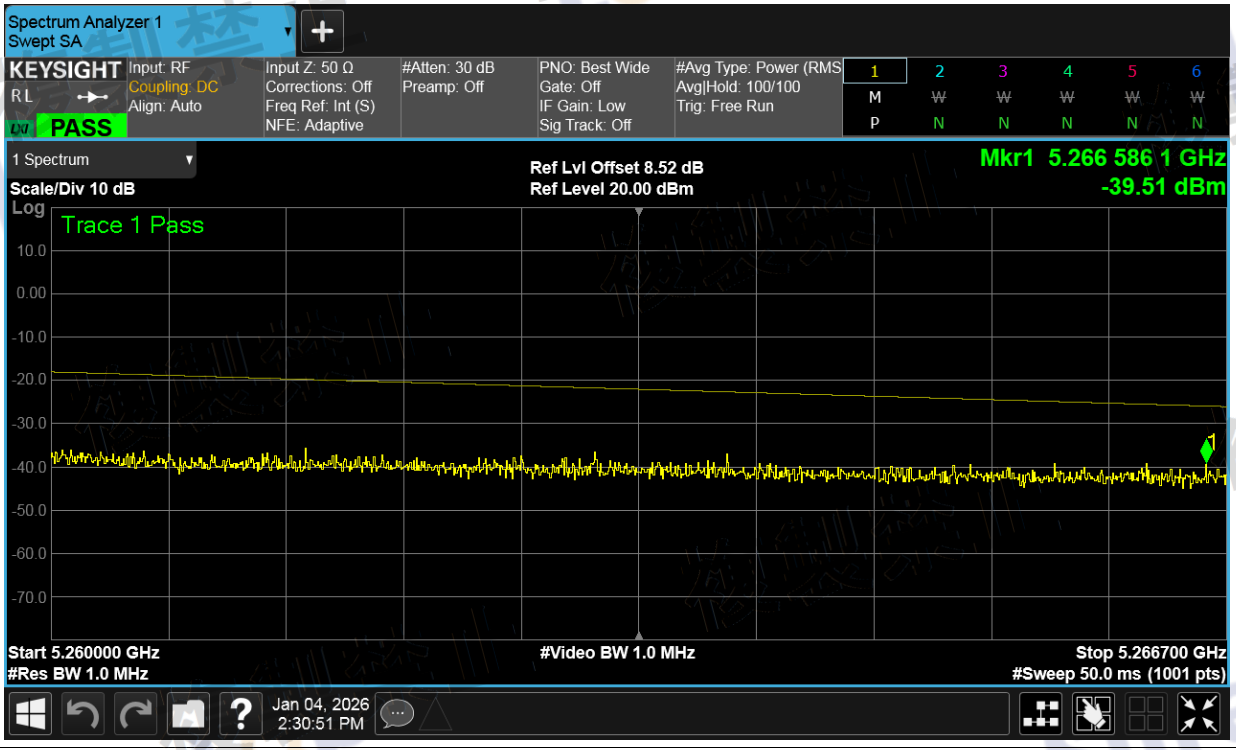


Tx. Spurious NVNT a 5240MHz Ant1 @ 5266.7MHz-26000MHz

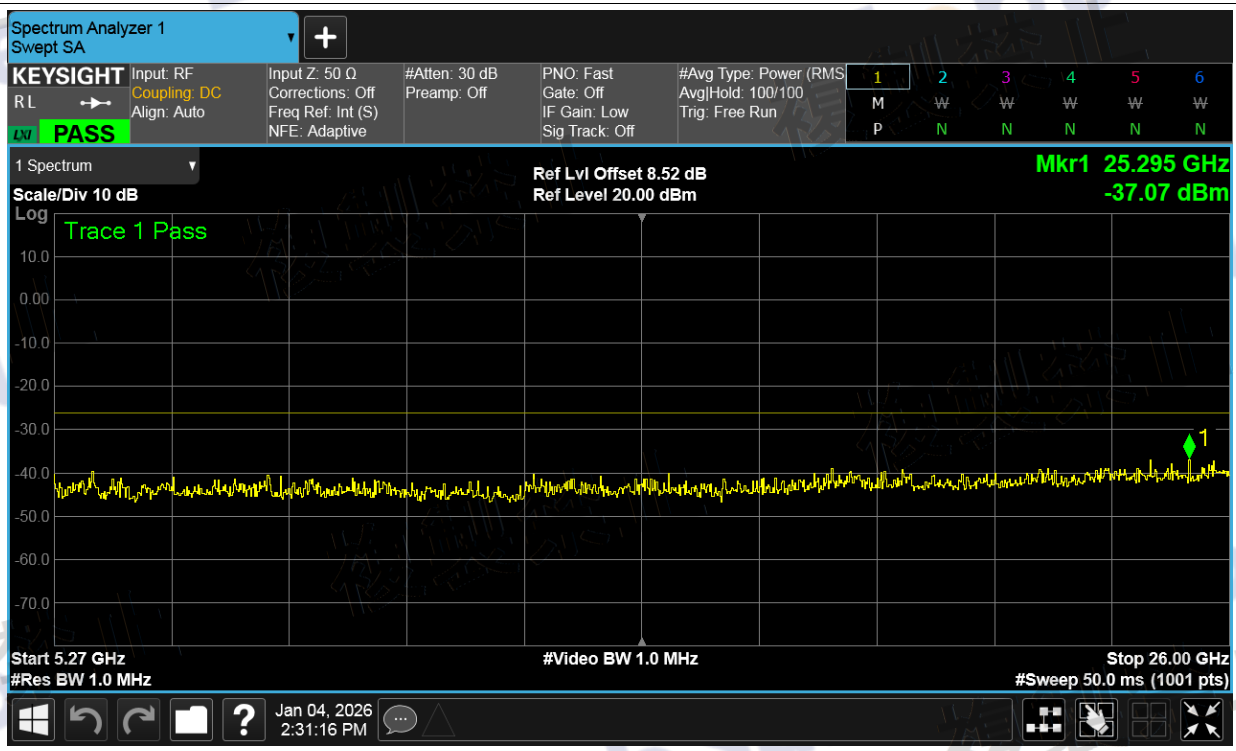


Tx. Spurious NVNT a 5260MHz Ant1 @ 30MHz-5233.3MHz

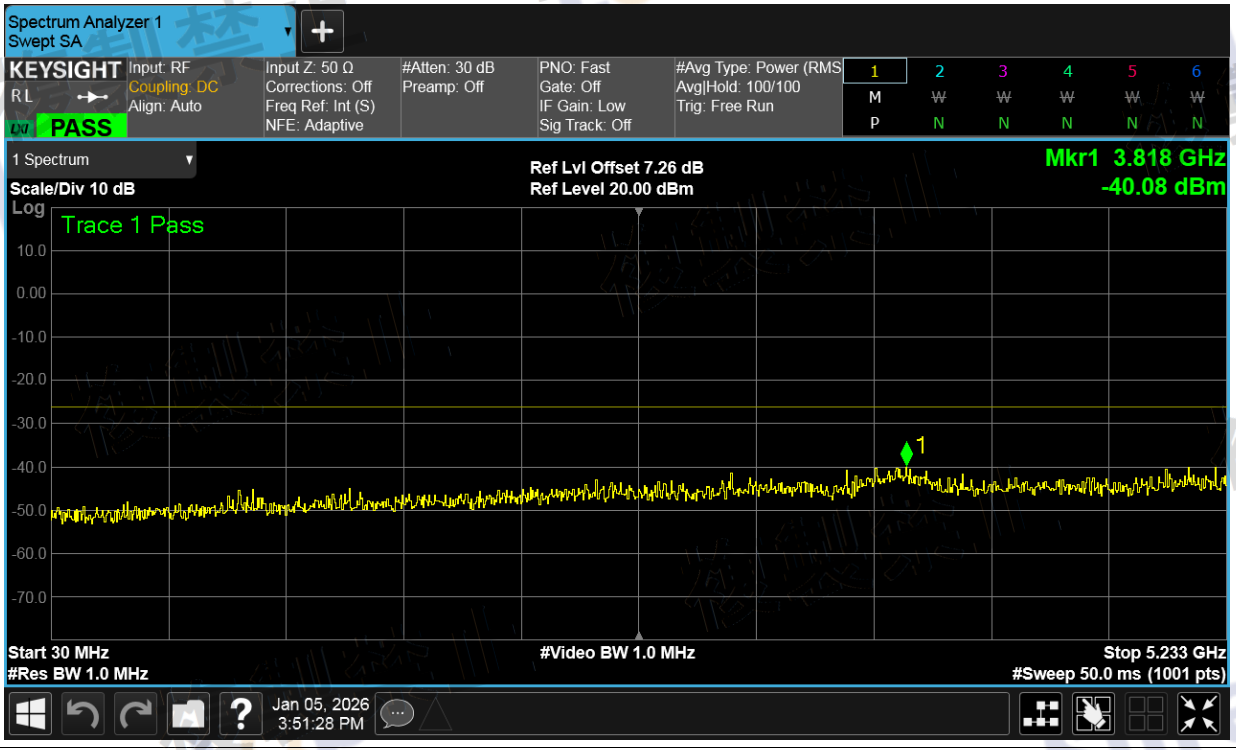


Tx. Spurious NVNT a 5260MHz Ant1 @ 5233.3MHz-5240MHz

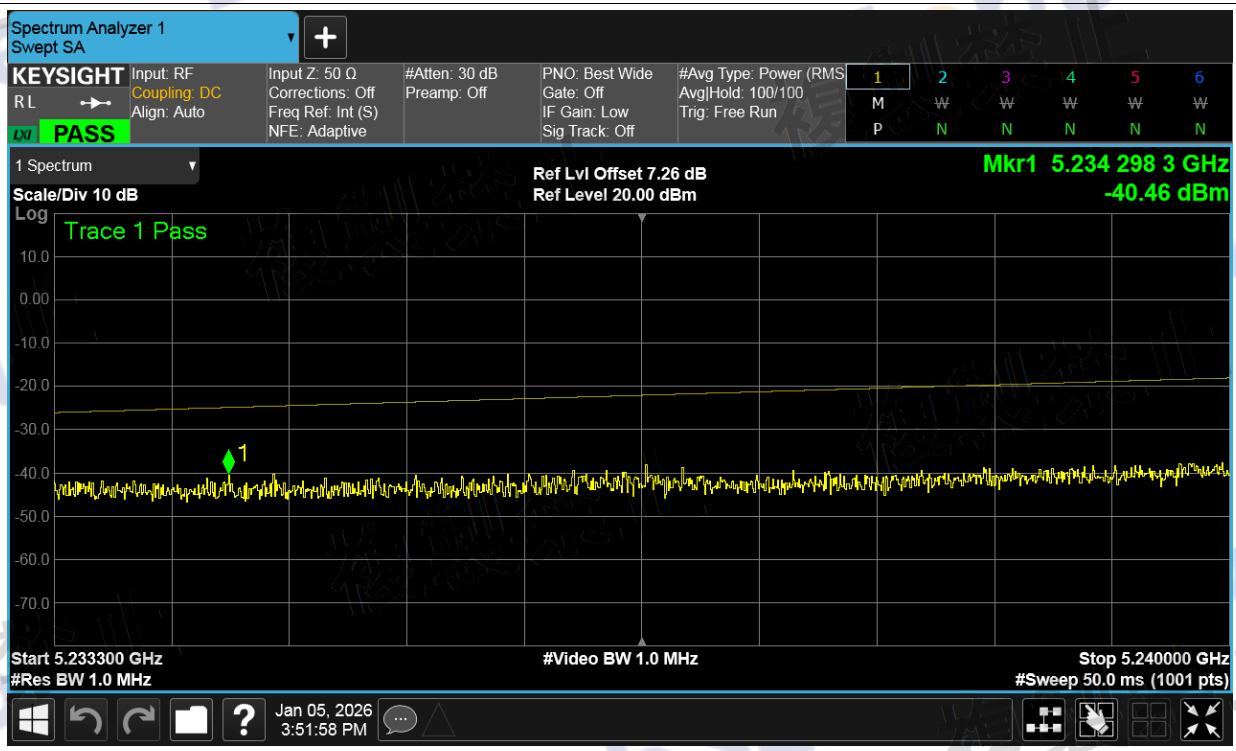


Tx. Spurious NVNT a 5260MHz Ant1 @ 5240MHz-5249MHz

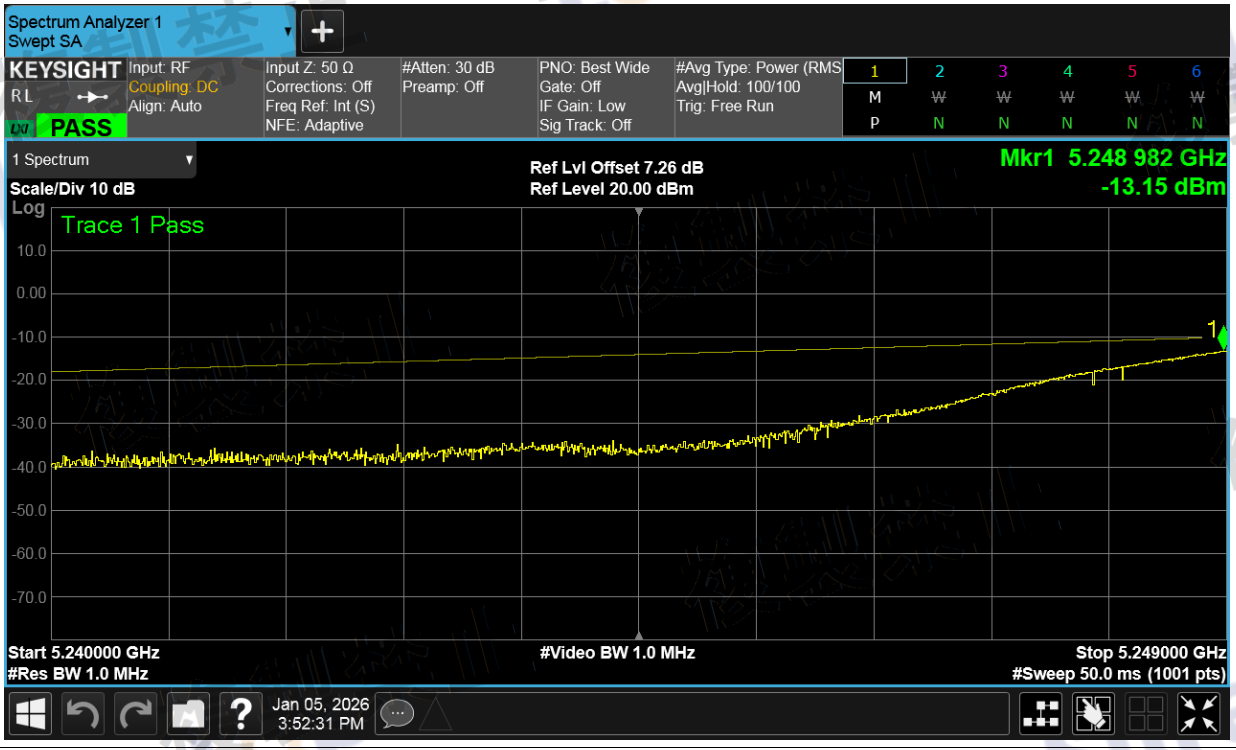


Tx. Spurious NVNT a 5260MHz Ant1 @ 5249MHz-5250MHz

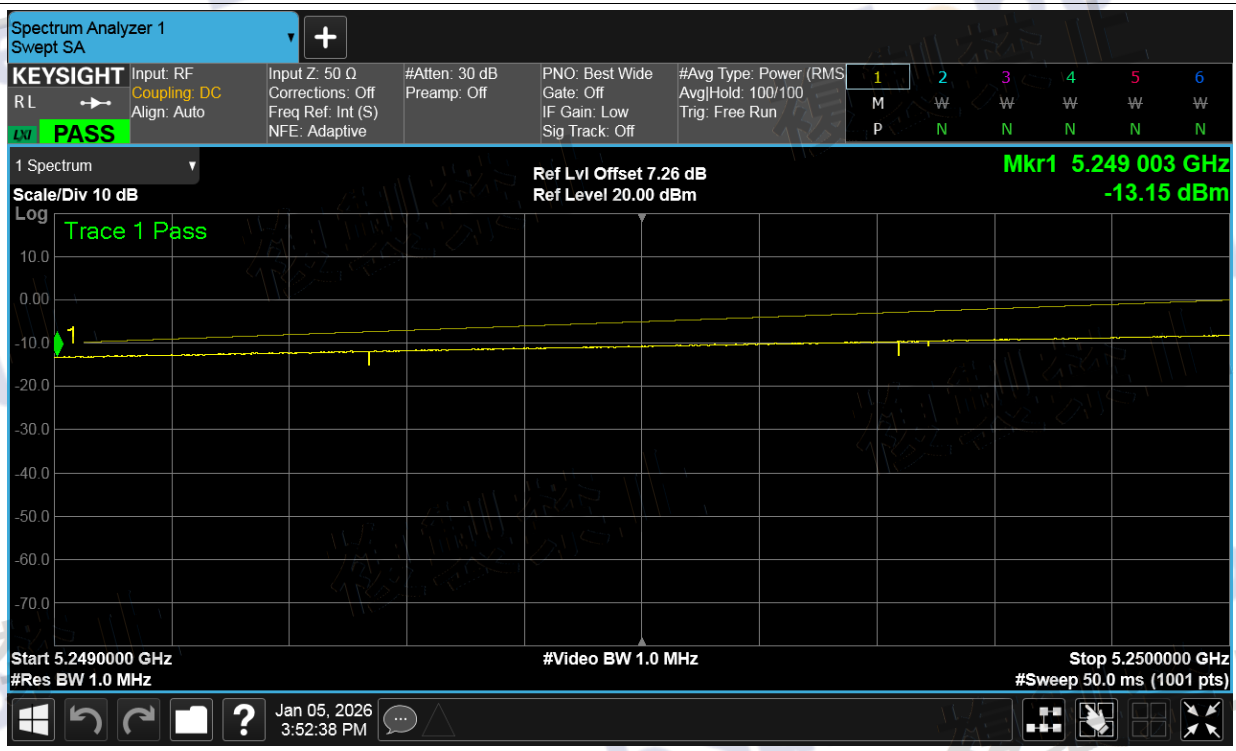


Tx. Spurious NVNT a 5260MHz Ant1 @ 5350MHz-26000MHz

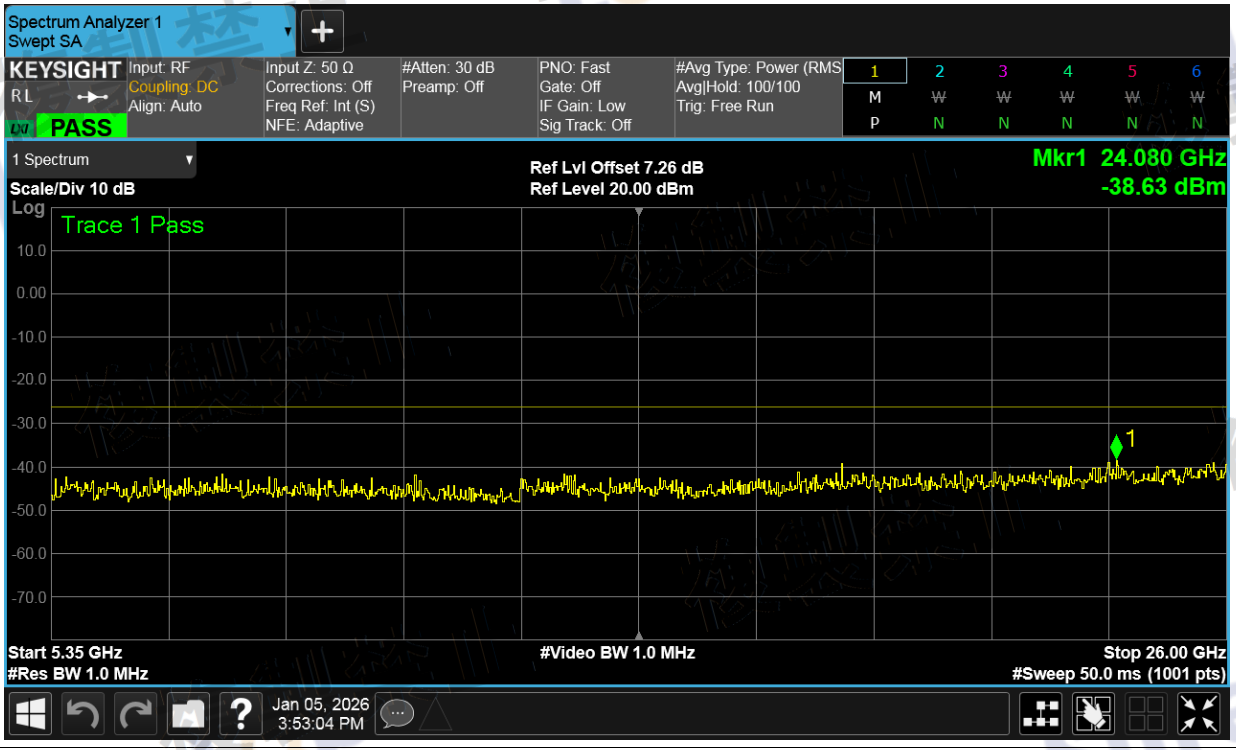


Tx. Spurious NVNT a 5300MHz Ant1 @ 30MHz-5233.3MHz

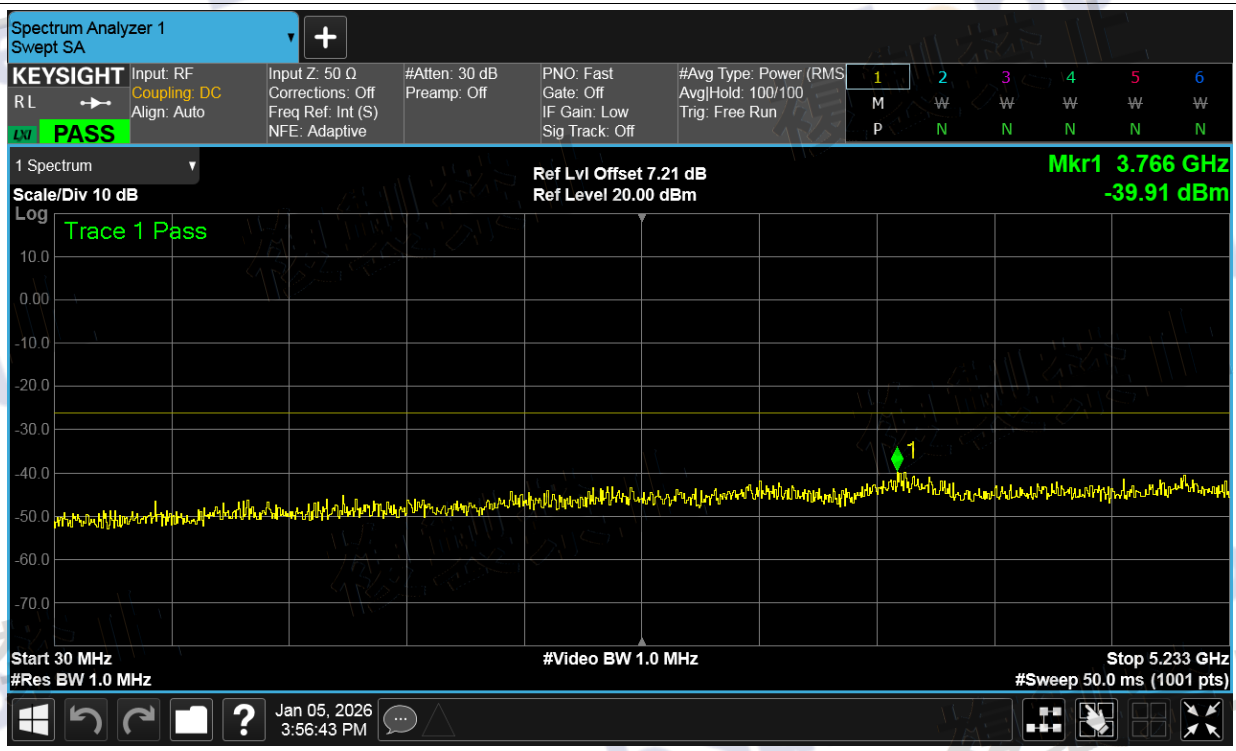


Tx. Spurious NVNT a 5300MHz Ant1 @ 5233.3MHz-5240MHz

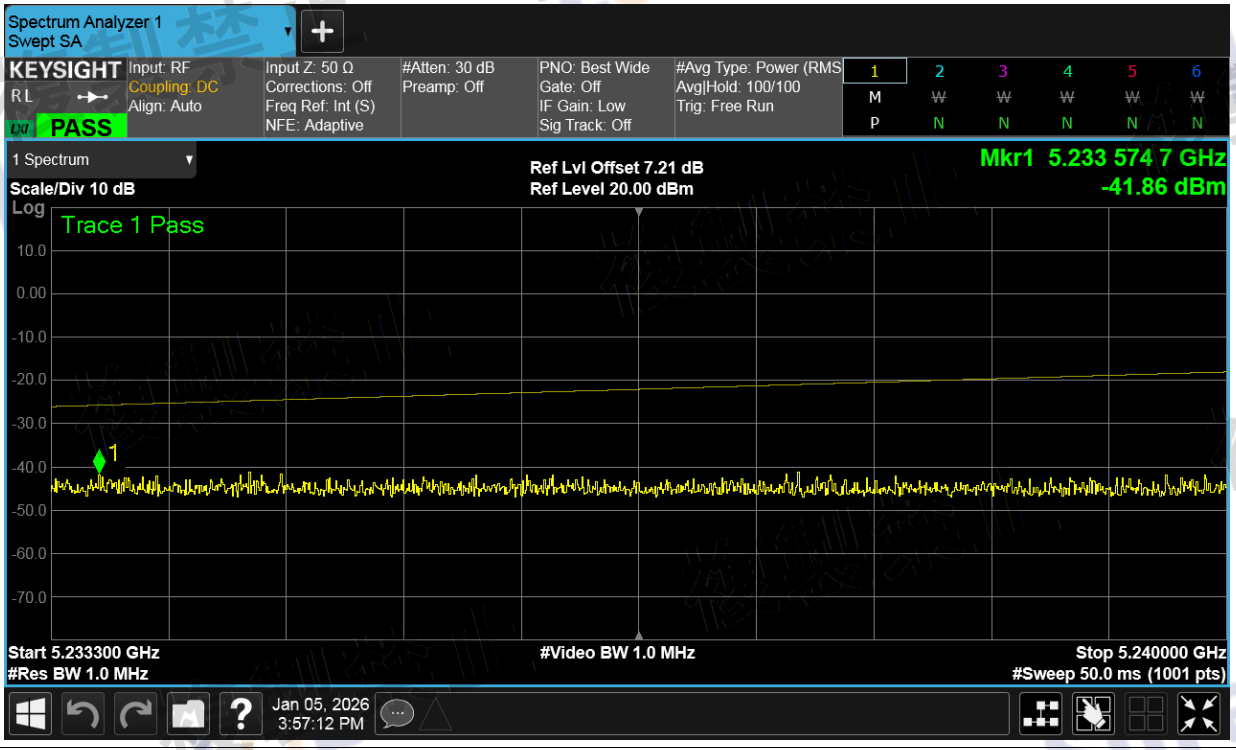


Tx. Spurious NVNT a 5300MHz Ant1 @ 5240MHz-5249MHz

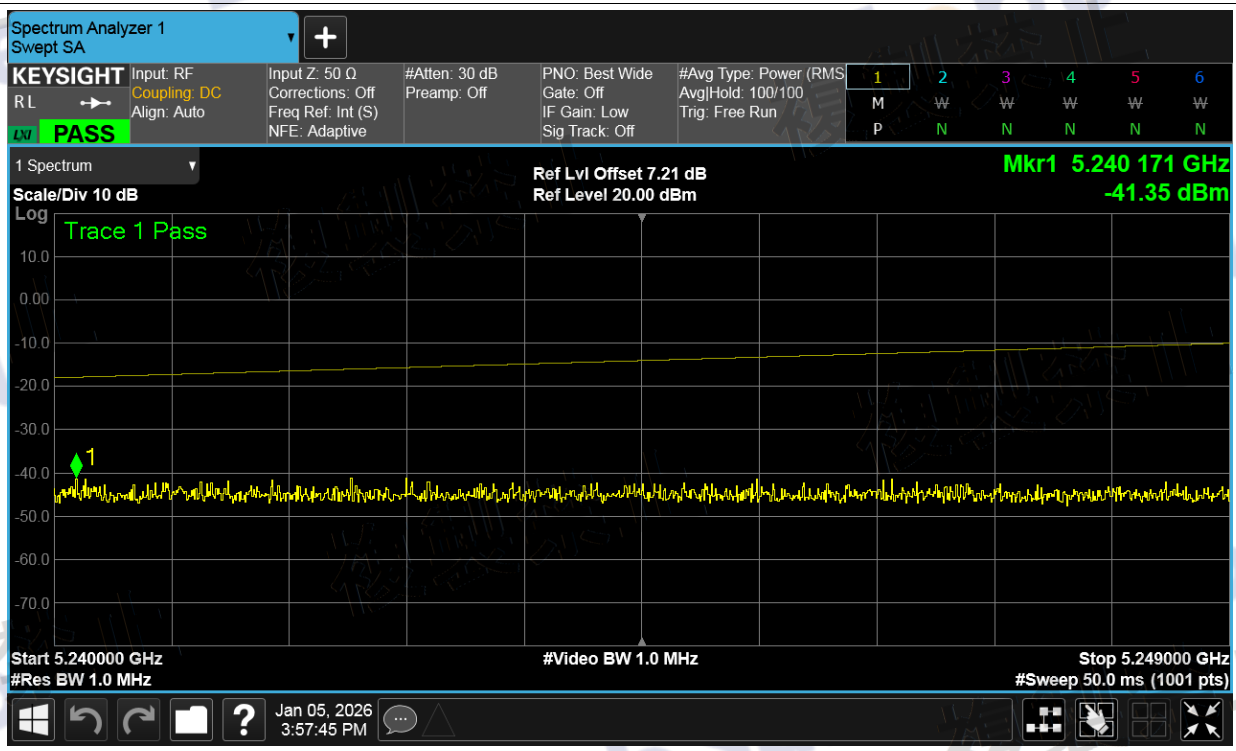


Tx. Spurious NVNT a 5300MHz Ant1 @ 5249MHz-5250MHz

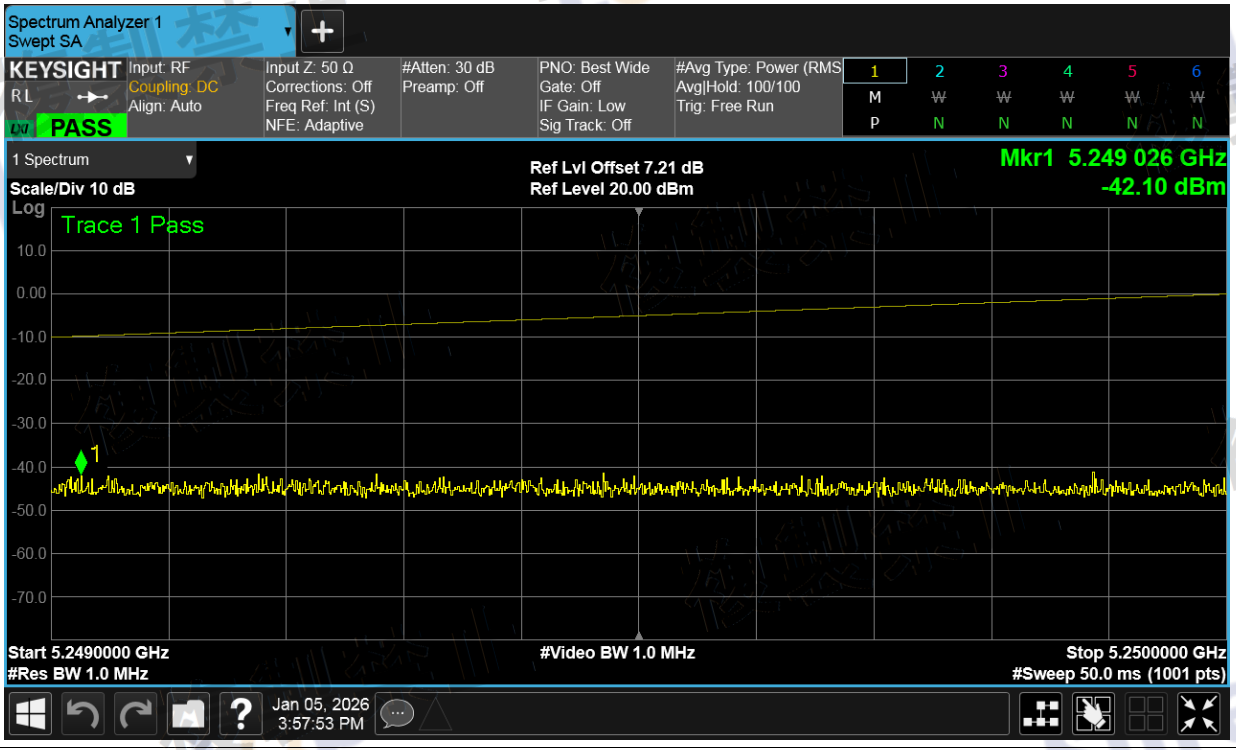


Tx. Spurious NVNT a 5300MHz Ant1 @ 5350MHz-26000MHz

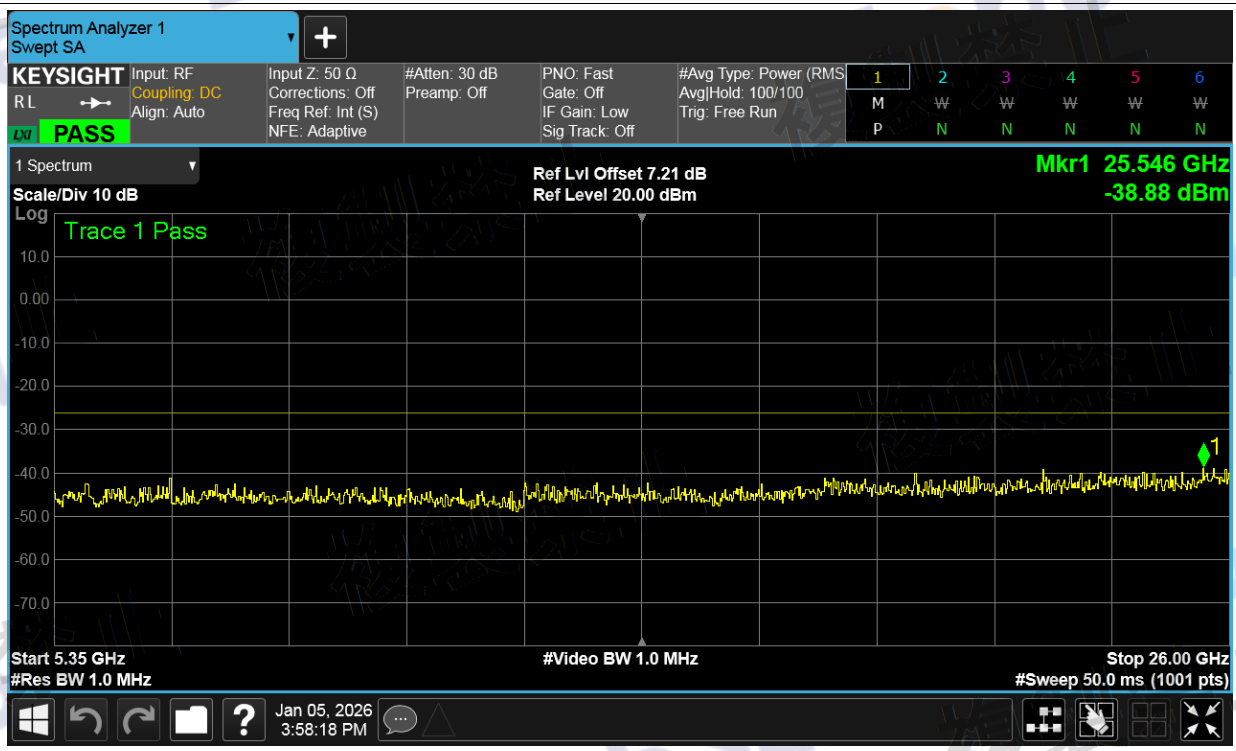


Tx. Spurious NVNT a 5320MHz Ant1 @ 30MHz-5233.3MHz

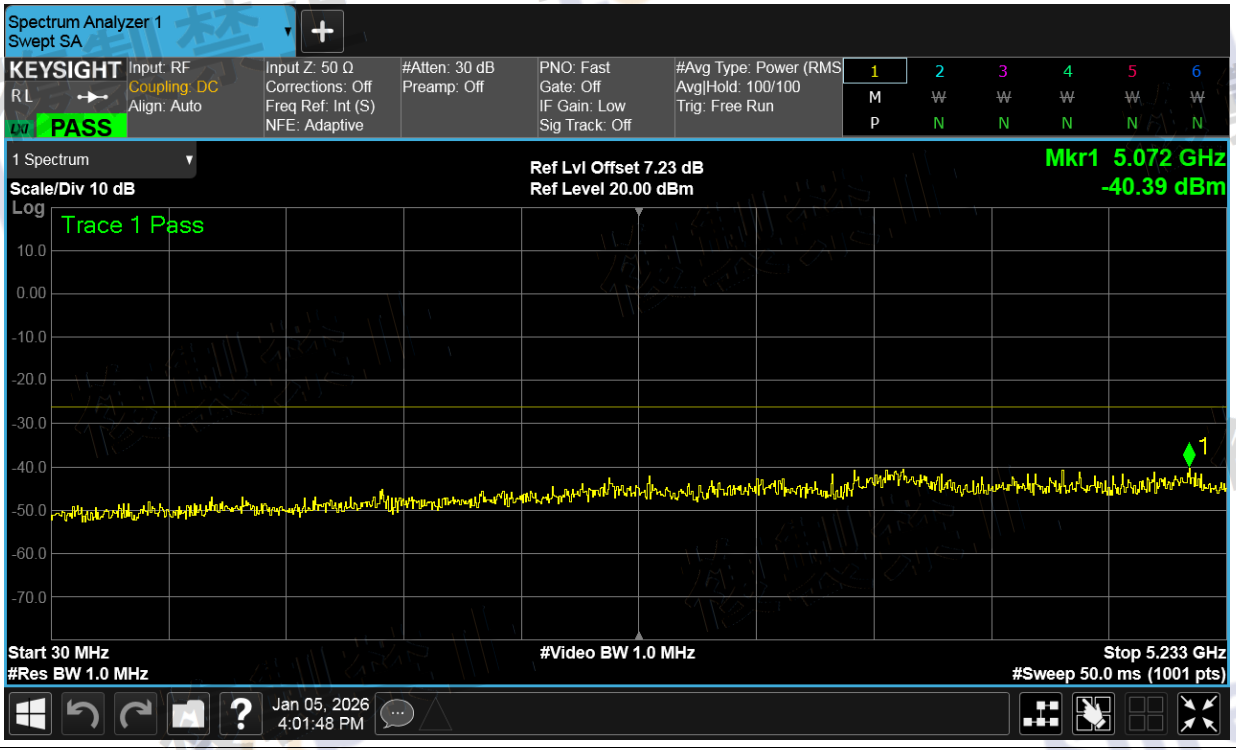


Tx. Spurious NVNT a 5320MHz Ant1 @ 5233.3MHz-5240MHz

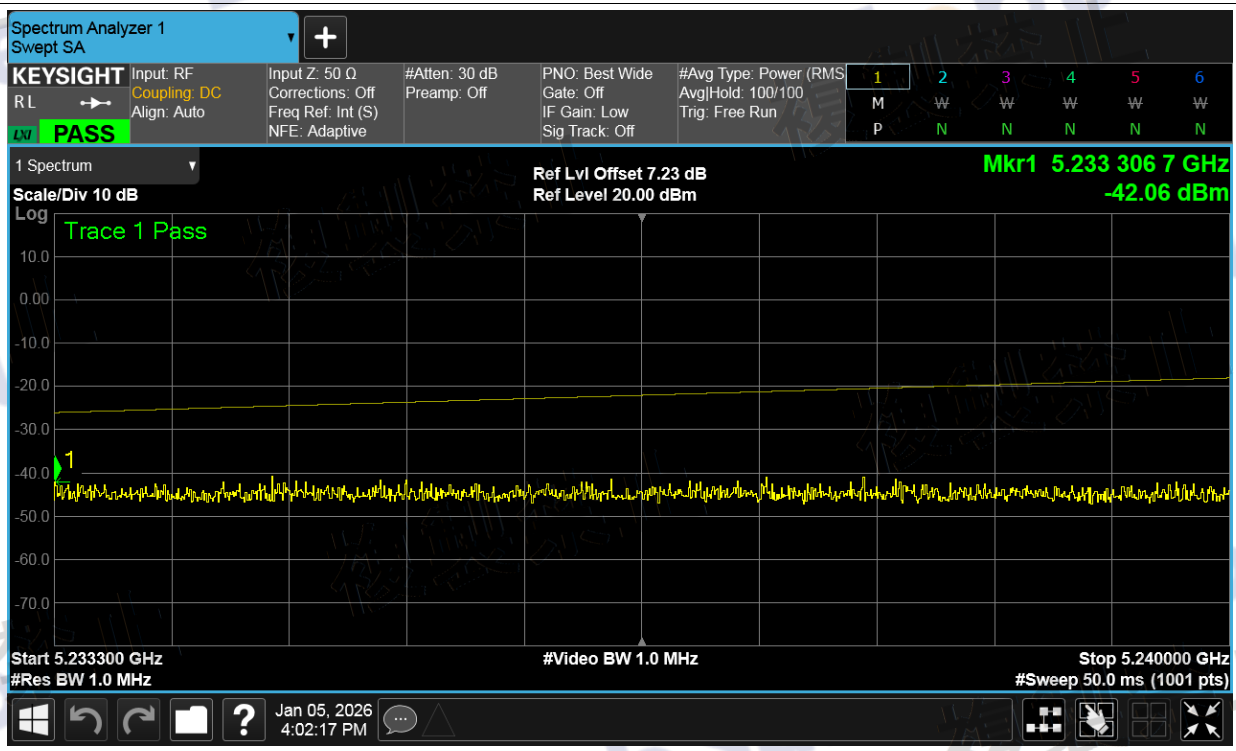


Tx. Spurious NVNT a 5320MHz Ant1 @ 5240MHz-5249MHz

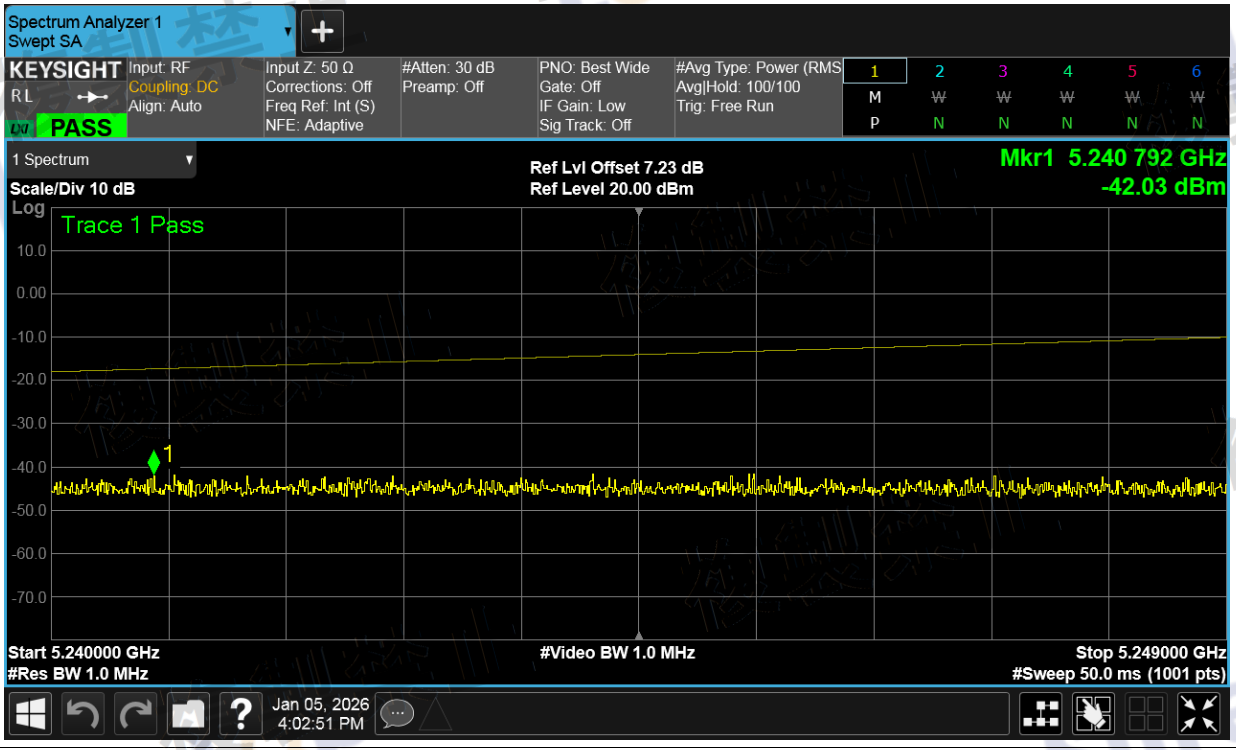


Tx. Spurious NVNT a 5320MHz Ant1 @ 5249MHz-5250MHz

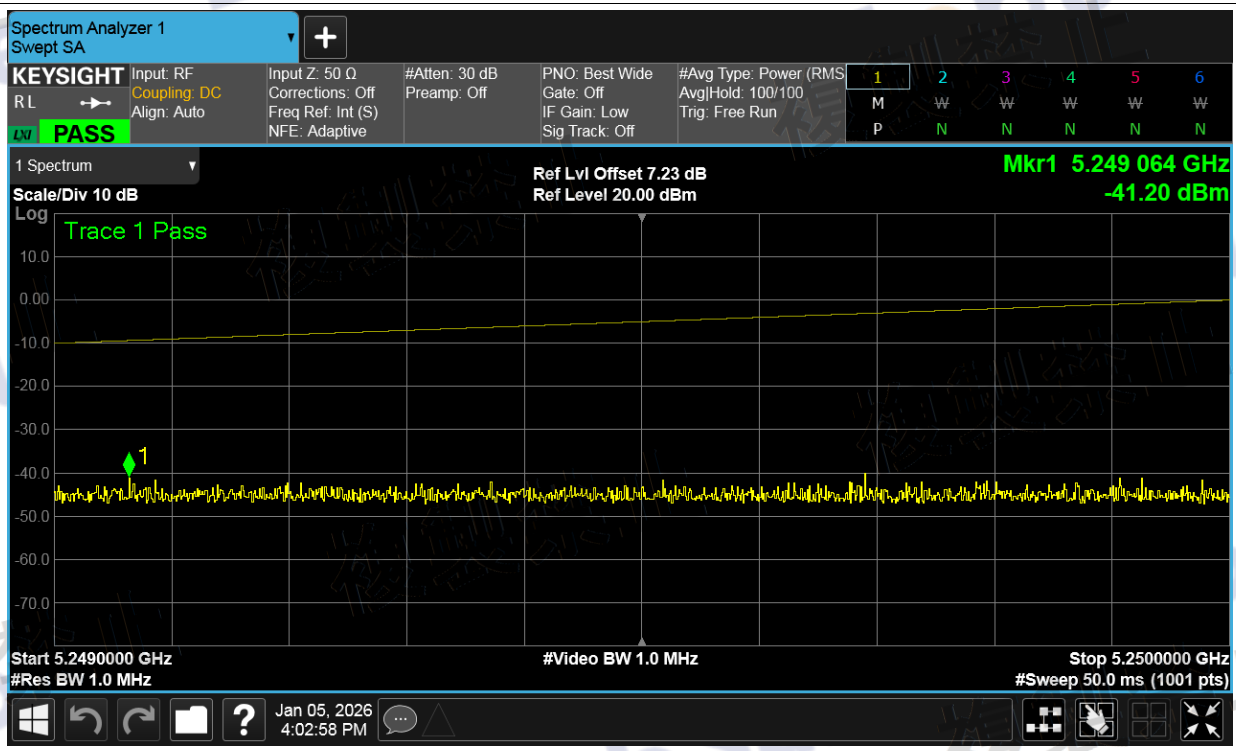


Tx. Spurious NVNT a 5320MHz Ant1 @ 5350MHz-26000MHz

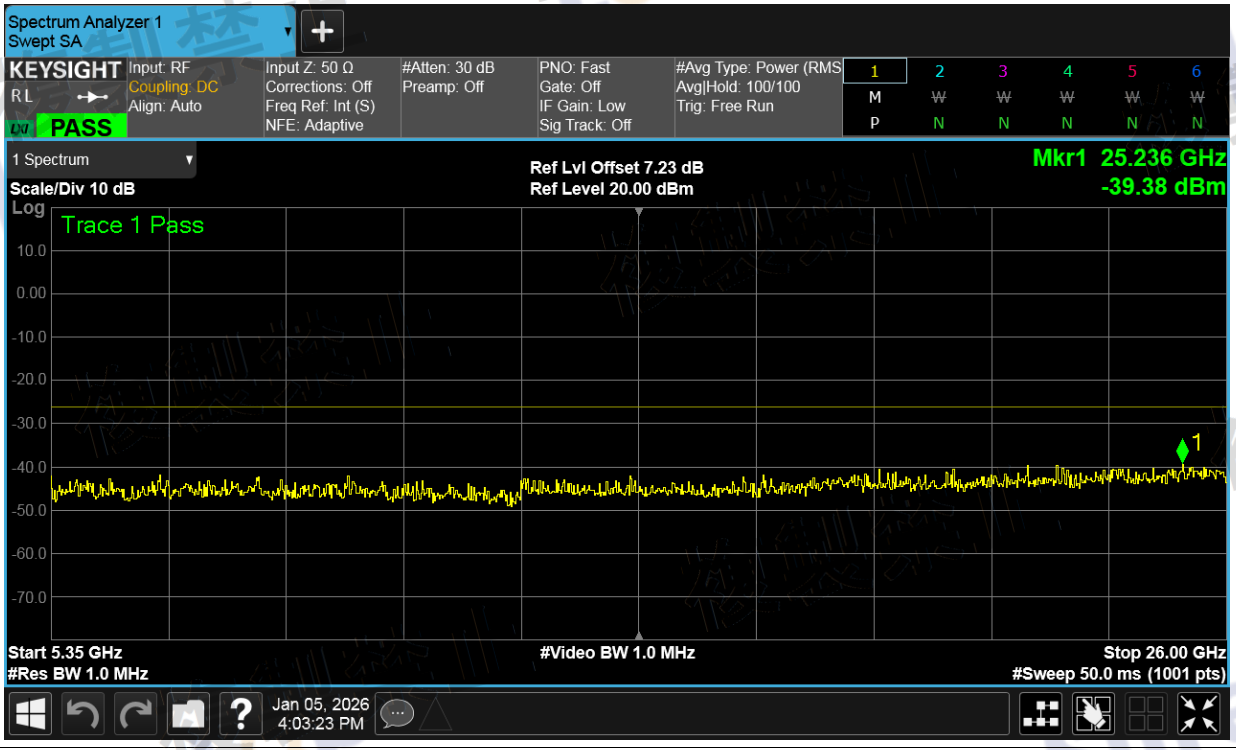


Tx. Spurious NVNT a 5500MHz Ant1 @ 30MHz-5460MHz

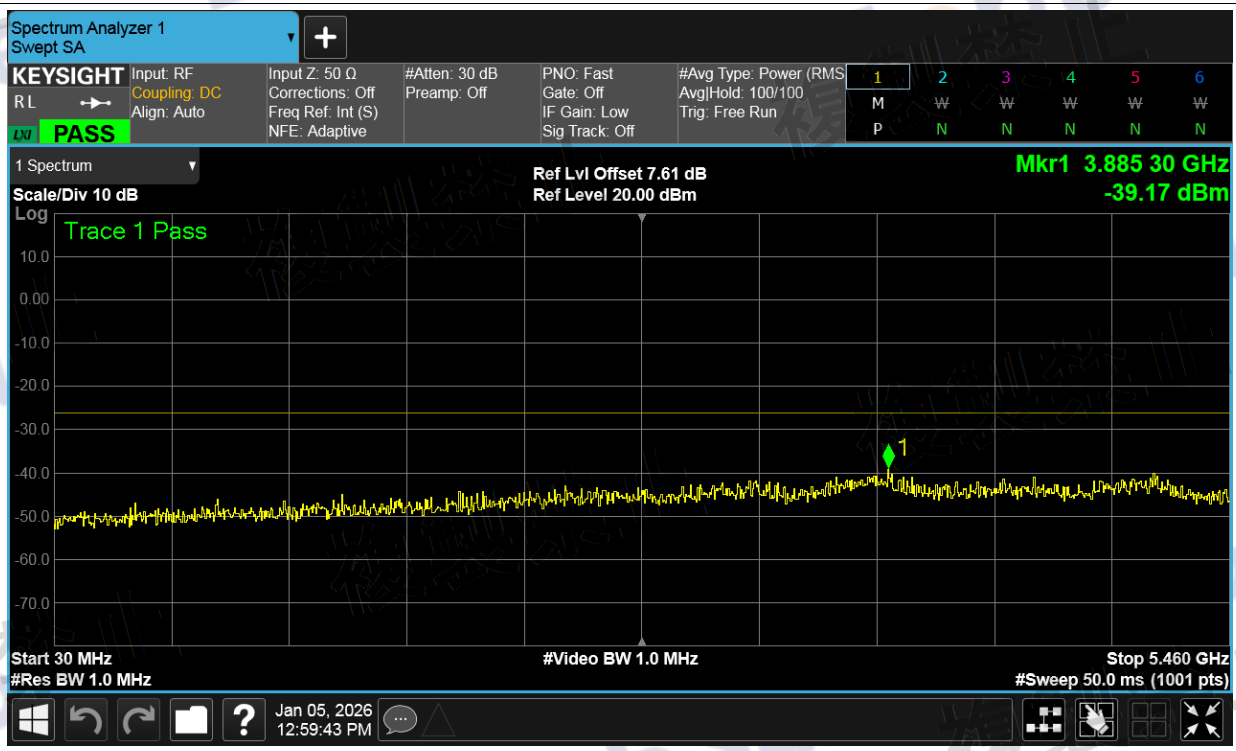


Tx. Spurious NVNT a 5500MHz Ant1 @ 5460MHz-5470MHz

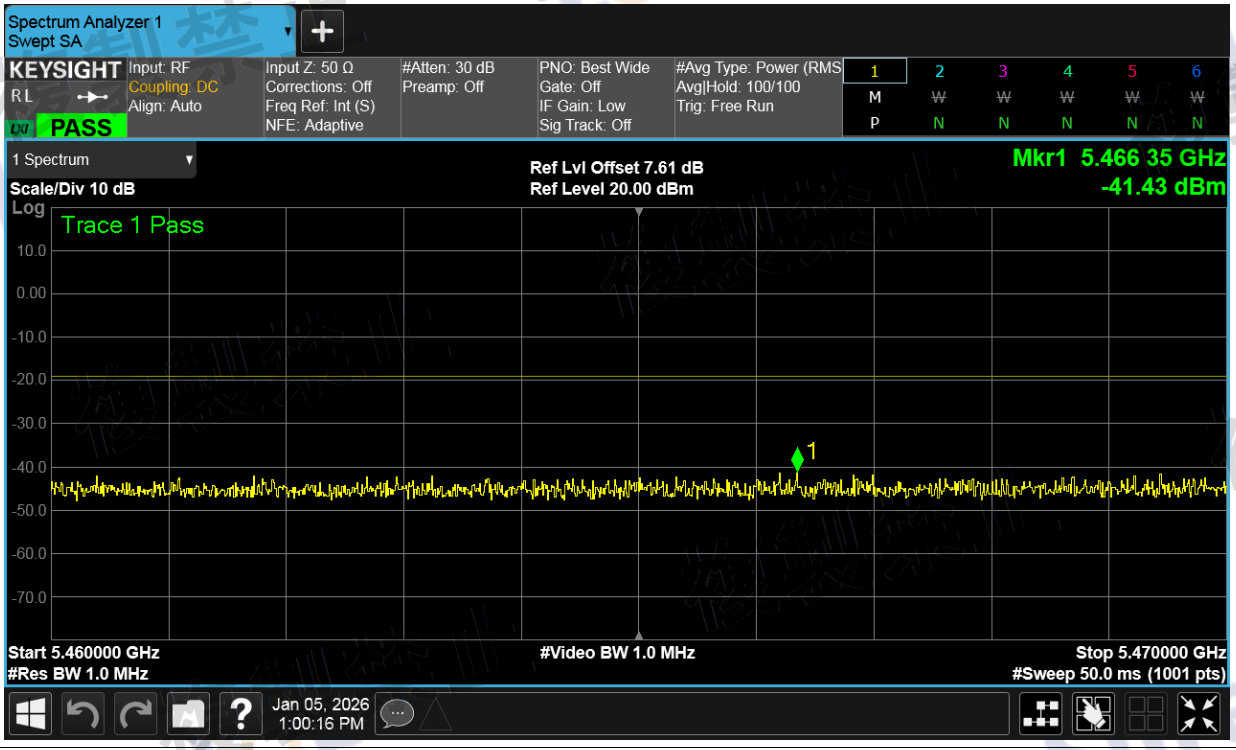


Tx. Spurious NVNT a 5500MHz Ant1 @ 5745MHz-5765MHz

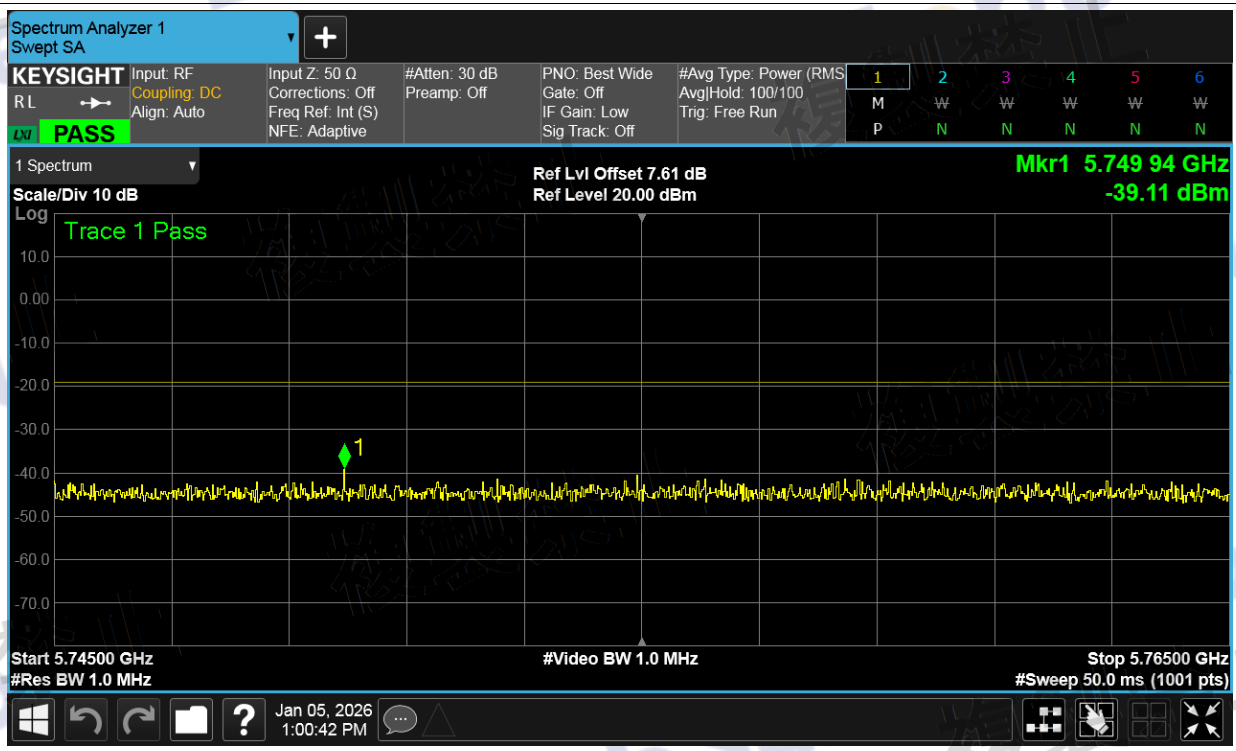


Tx. Spurious NVNT a 5500MHz Ant1 @ 5765MHz-26000MHz

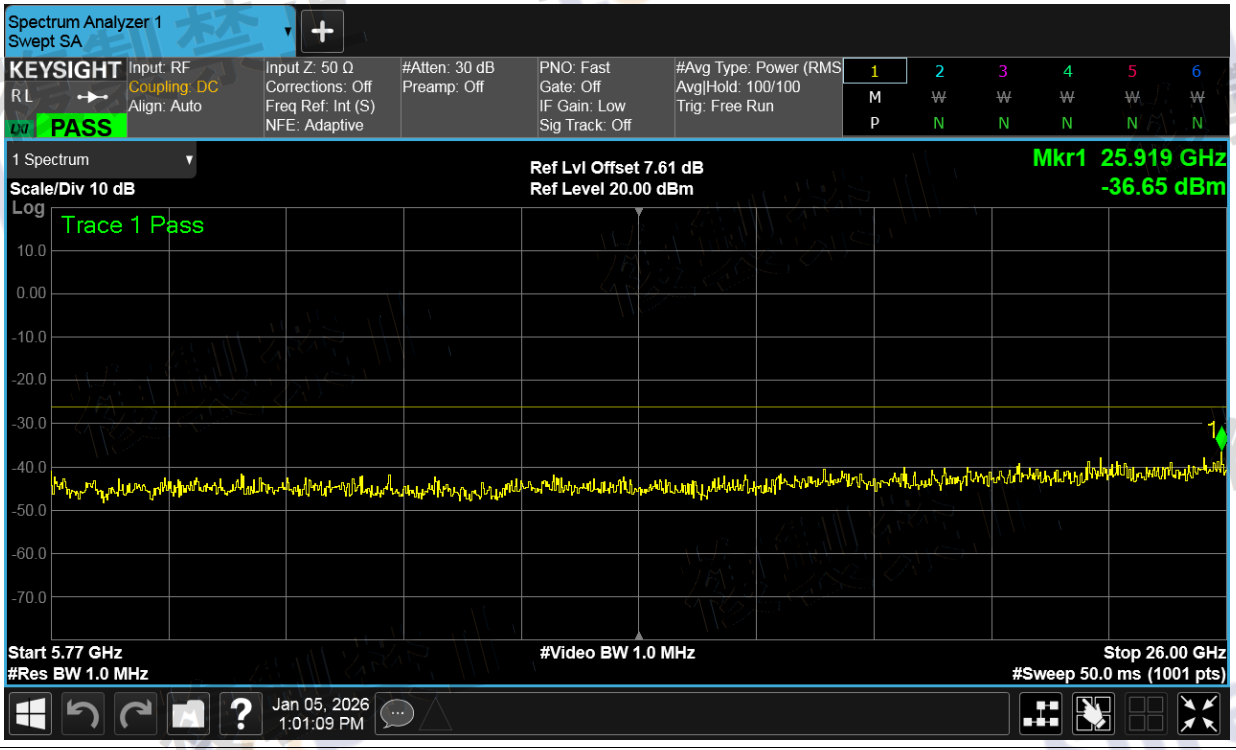


Tx. Spurious NVNT a 5580MHz Ant1 @ 30MHz-5460MHz

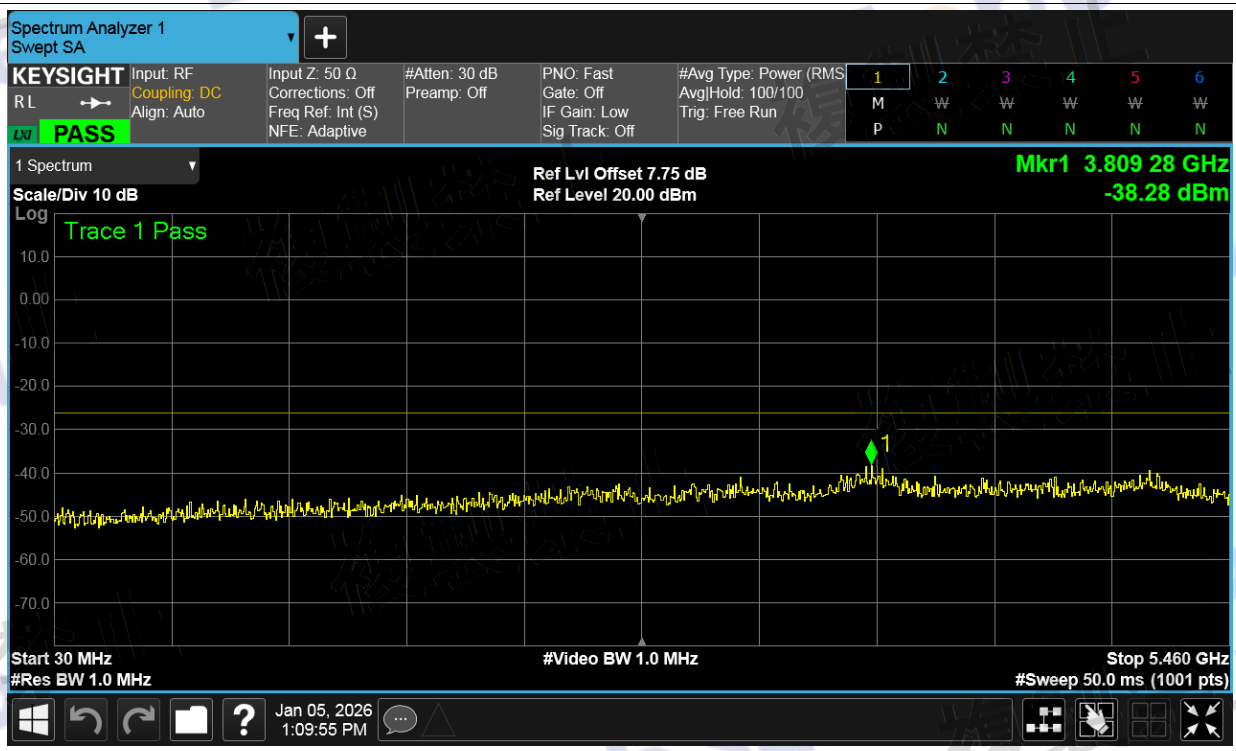


Tx. Spurious NVNT a 5580MHz Ant1 @ 5460MHz-5470MHz

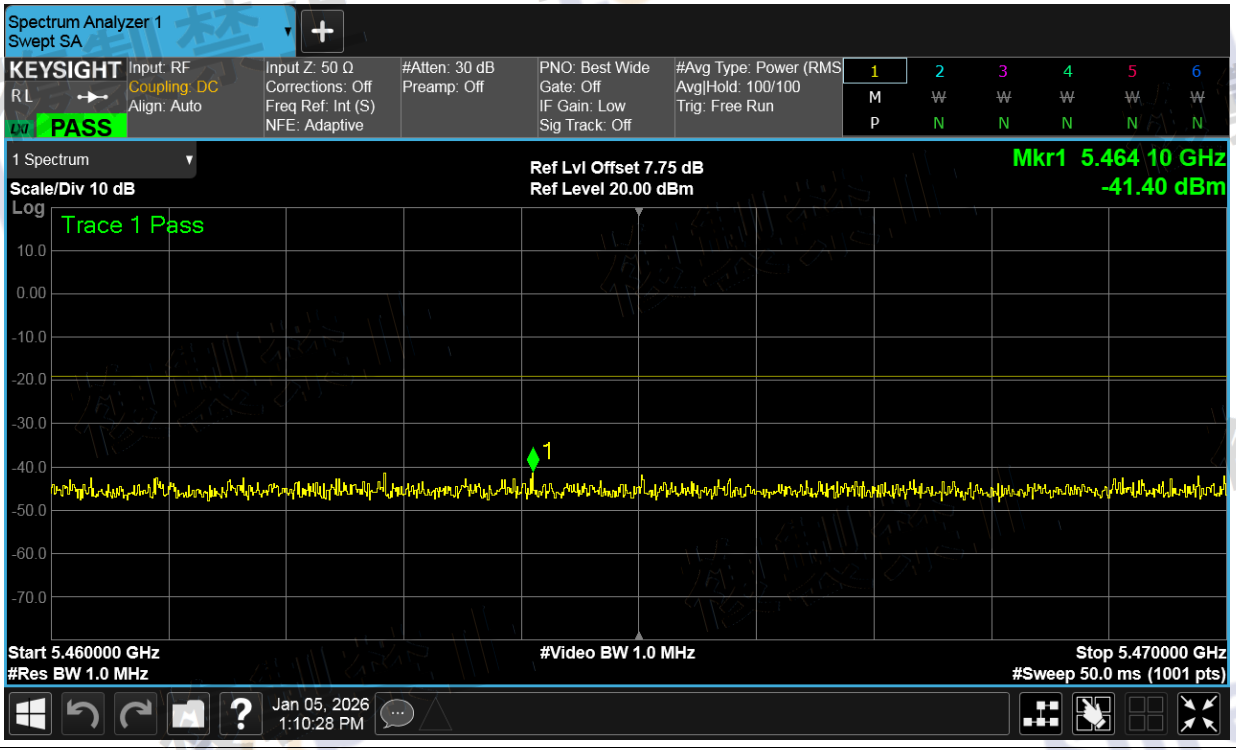


Tx. Spurious NVNT a 5580MHz Ant1 @ 5745MHz-5765MHz

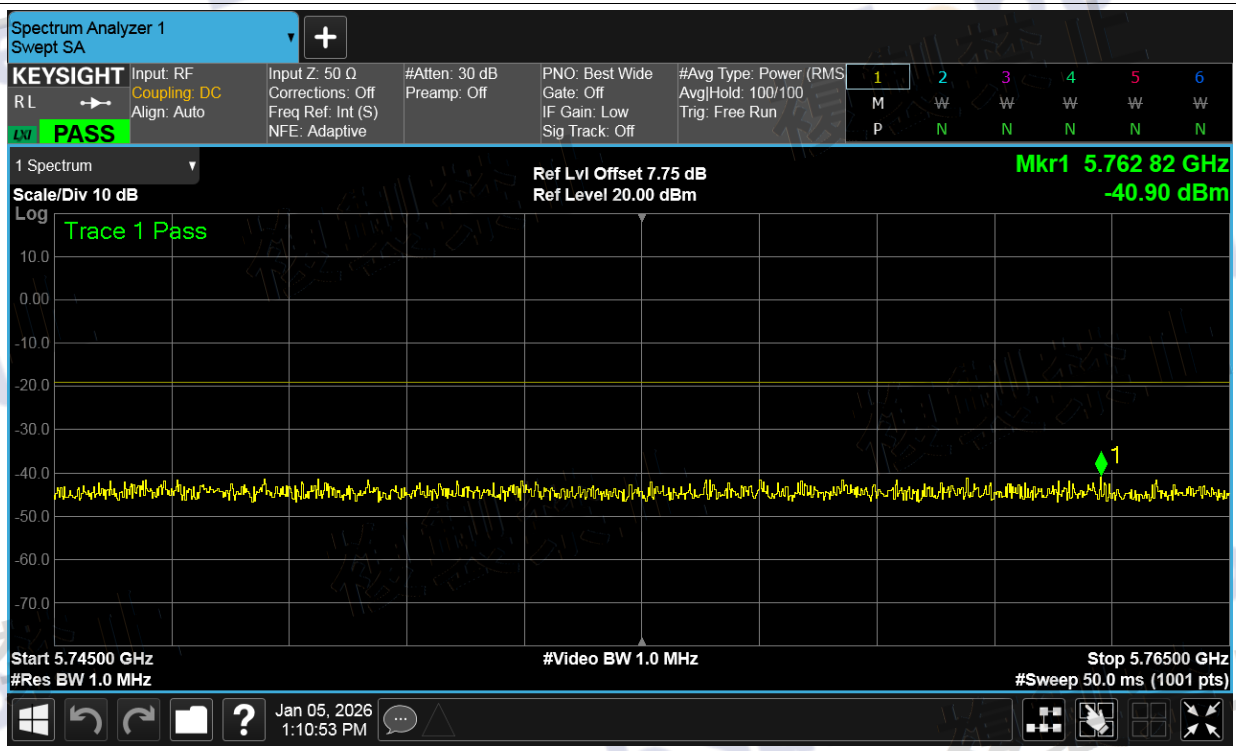


Tx. Spurious NVNT a 5580MHz Ant1 @ 5765MHz-26000MHz

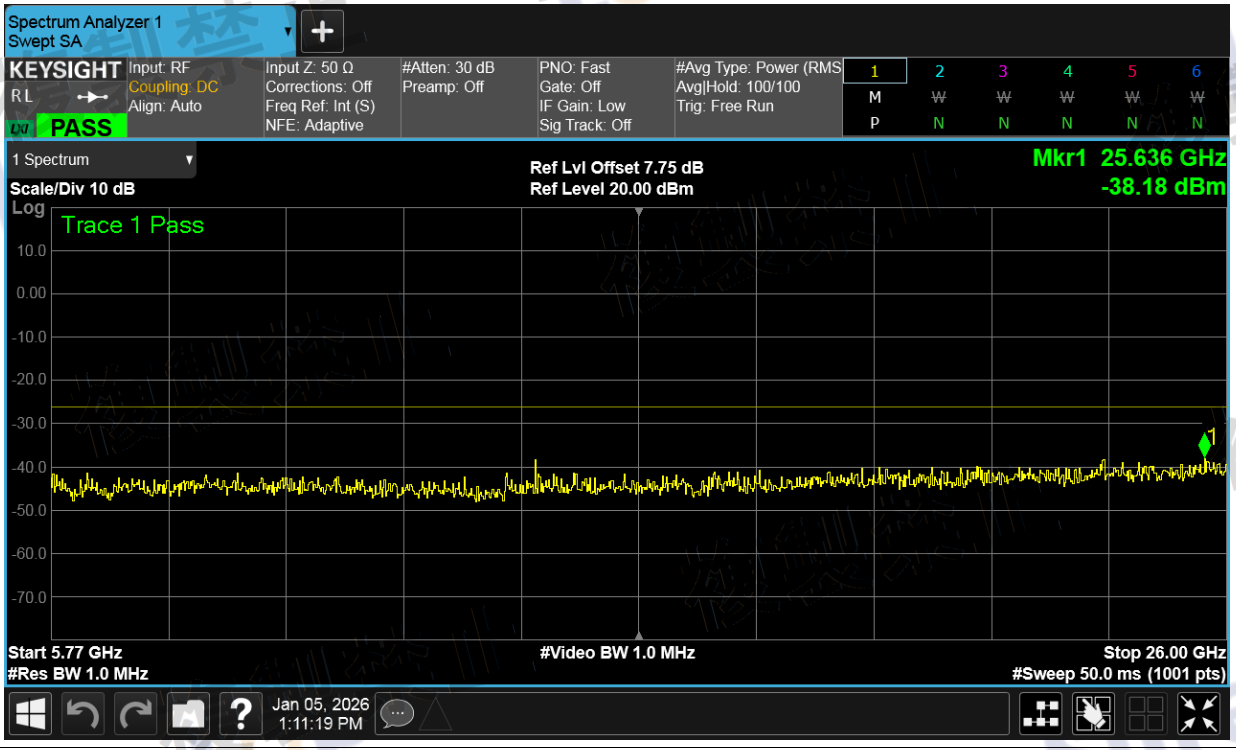


Tx. Spurious NVNT a 5700MHz Ant1 @ 30MHz-5460MHz

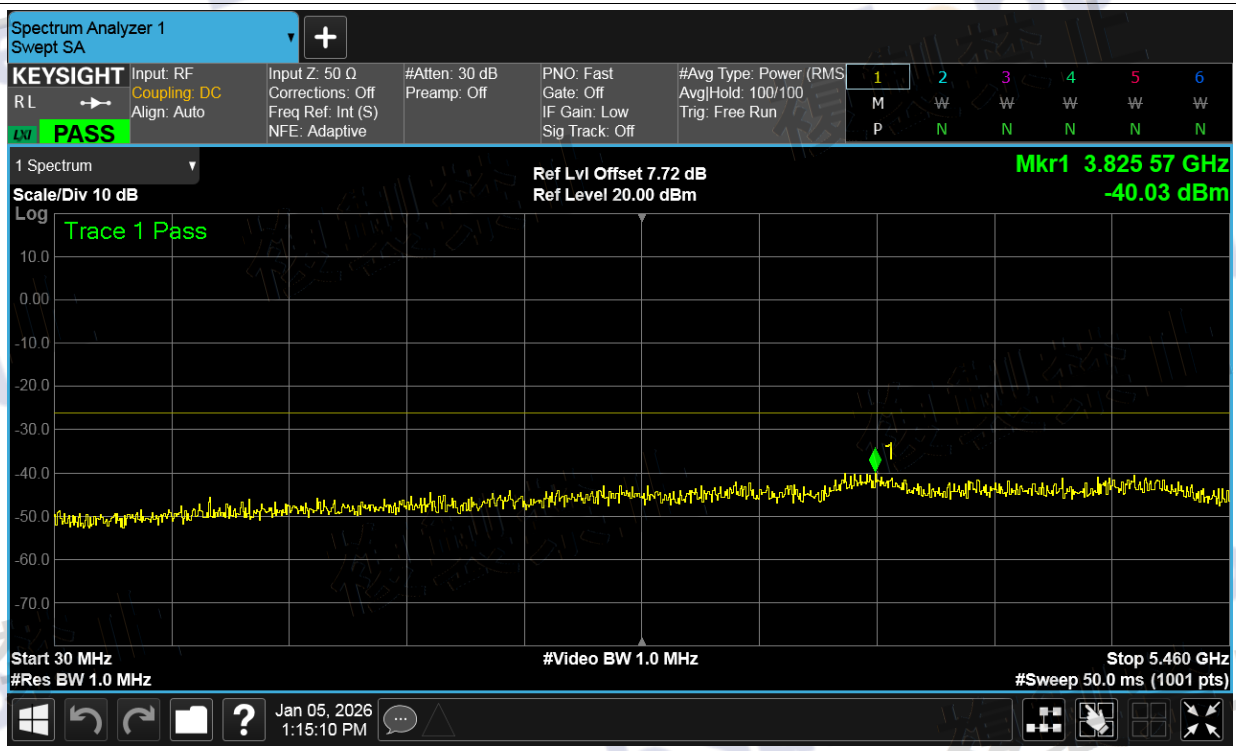


Tx. Spurious NVNT a 5700MHz Ant1 @ 5460MHz-5470MHz

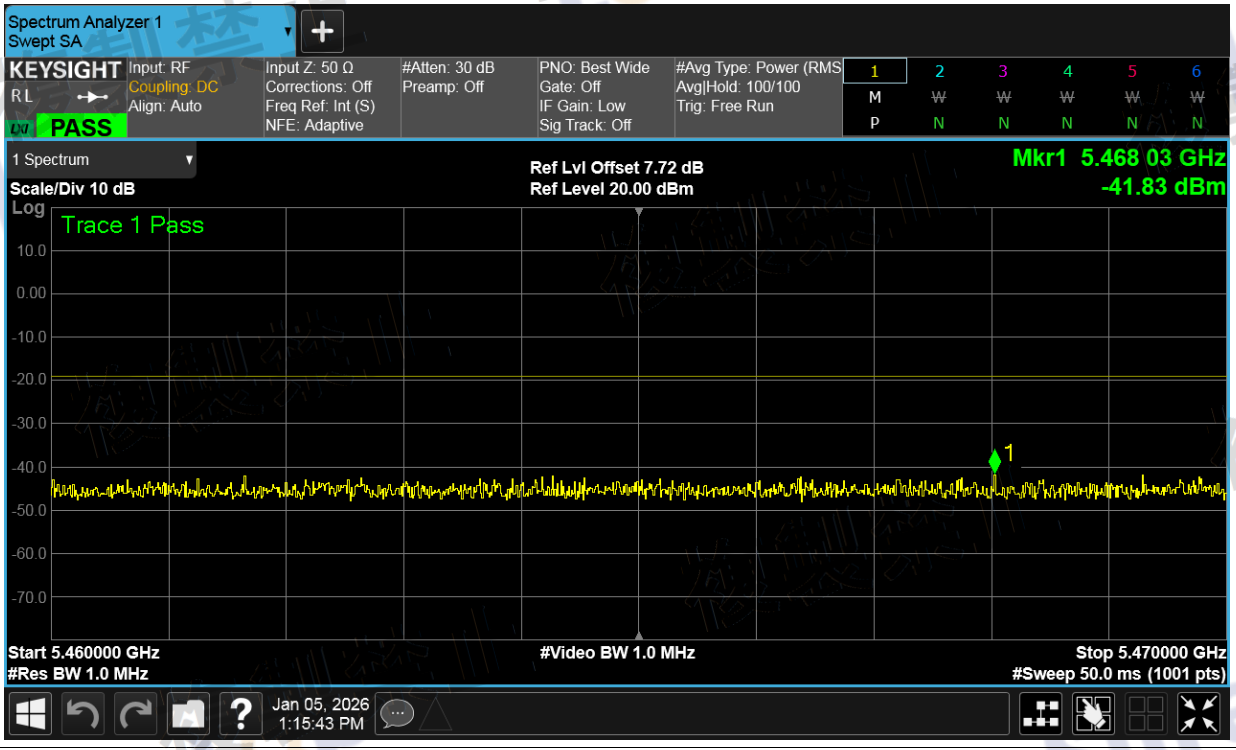


Tx. Spurious NVNT a 5700MHz Ant1 @ 5745MHz-5765MHz

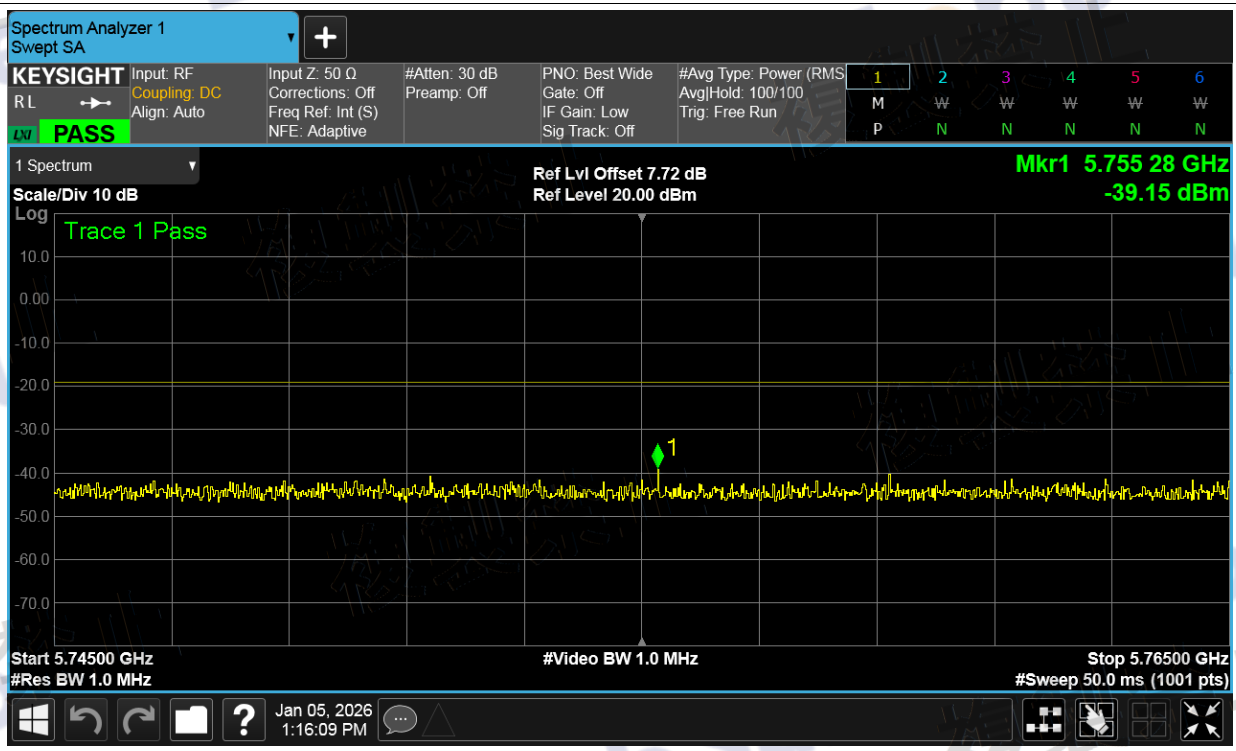


Tx. Spurious NVNT a 5700MHz Ant1 @ 5765MHz-26000MHz

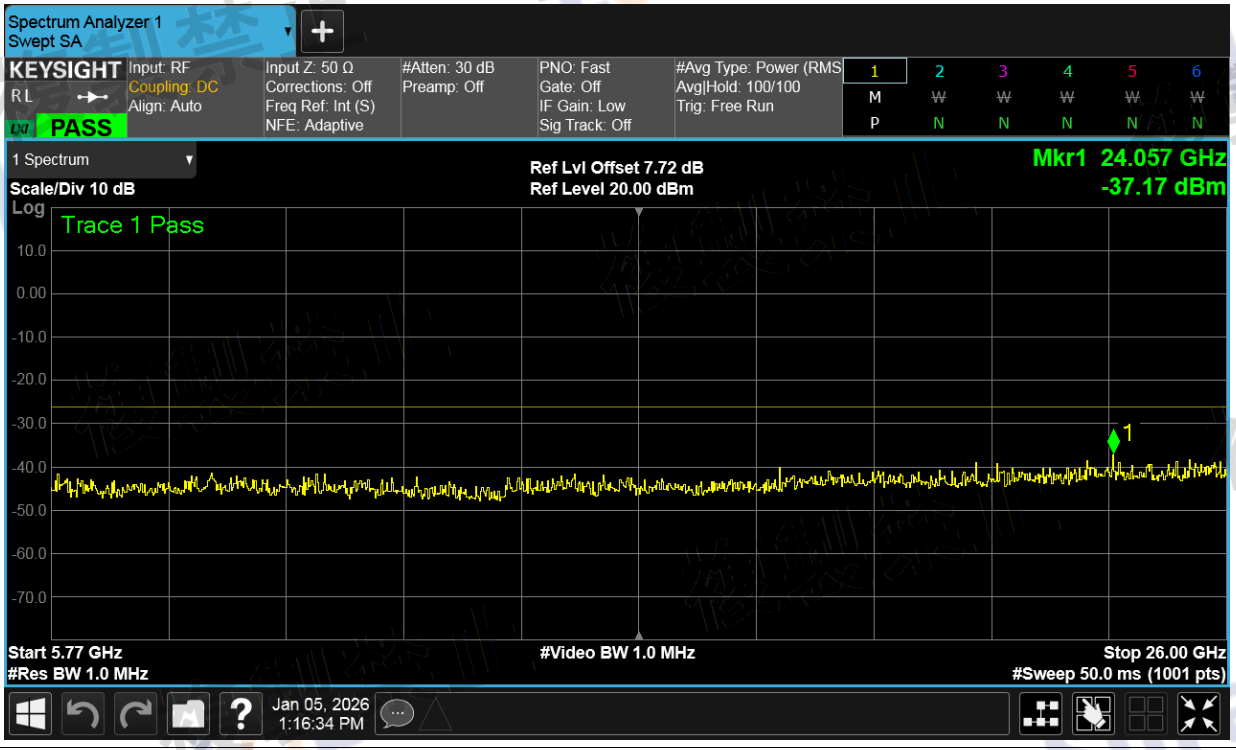


Tx. Spurious NVNT n20 5180MHz Ant1 @ 30MHz-5142MHz

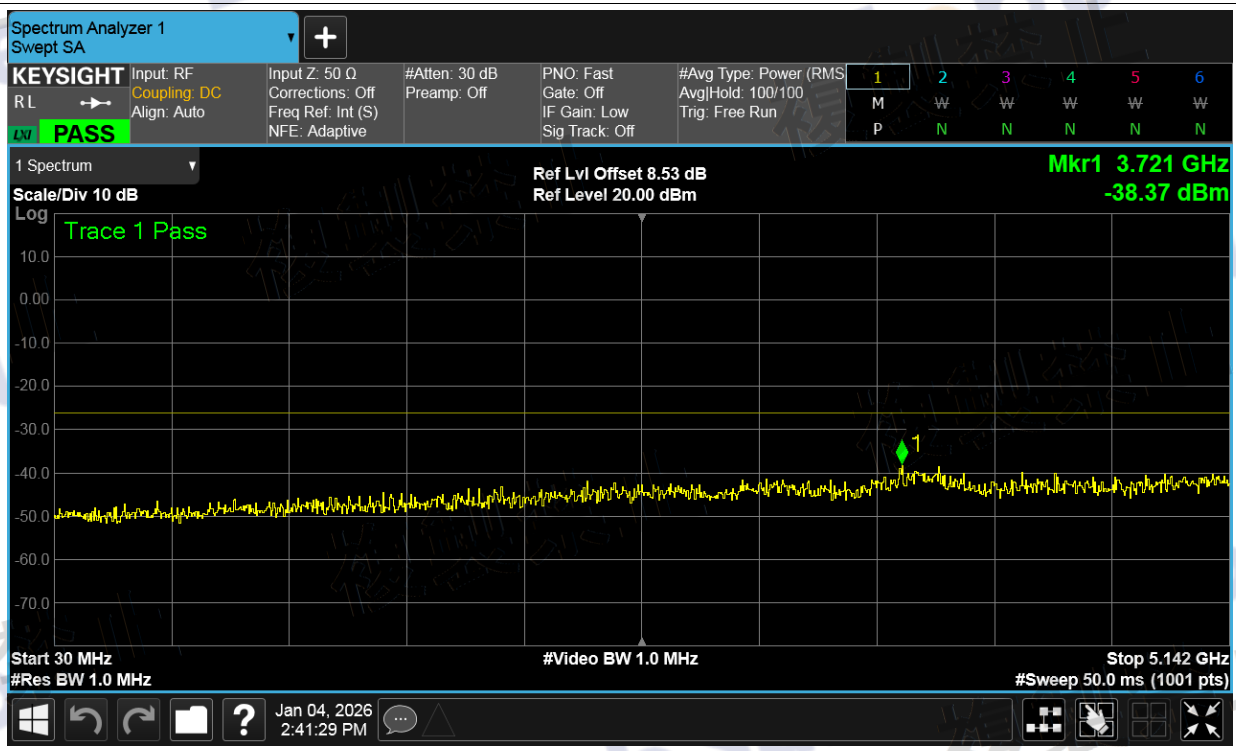


Tx. Spurious NVNT n20 5180MHz Ant1 @ 5142MHz-5150MHz

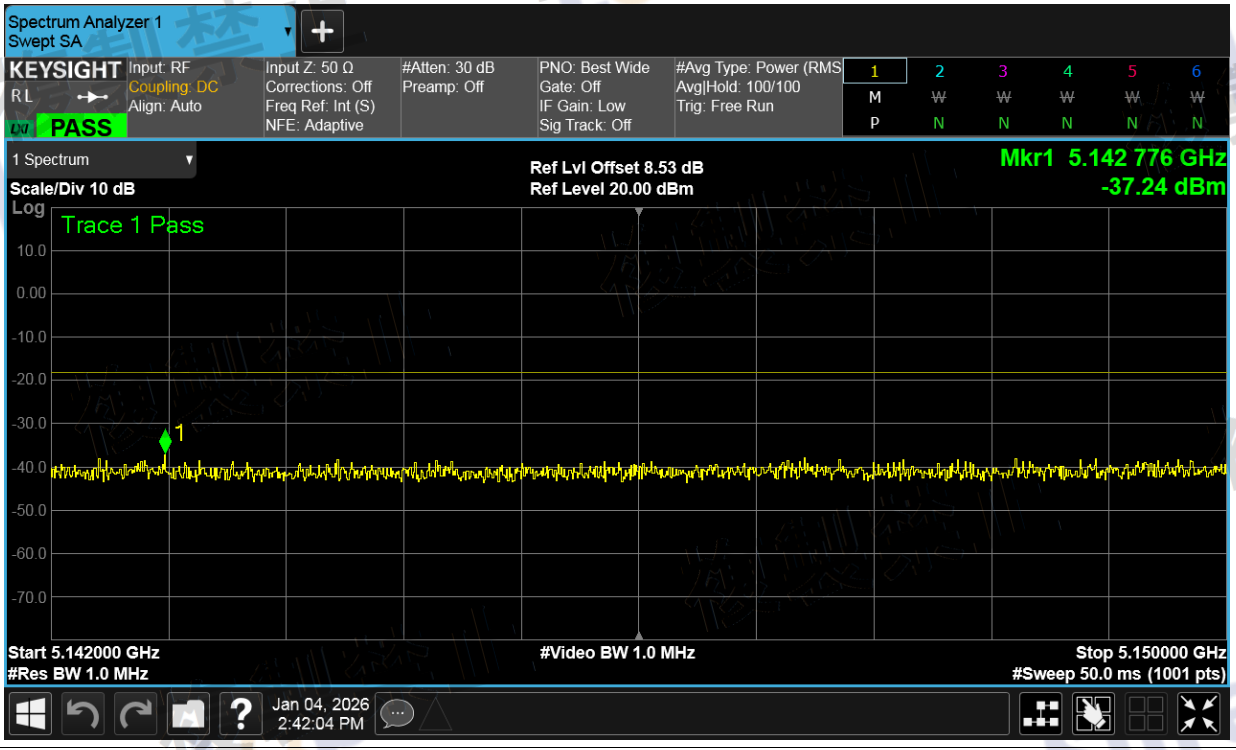


Tx. Spurious NVNT n20 5180MHz Ant1 @ 5250MHz-5251MHz

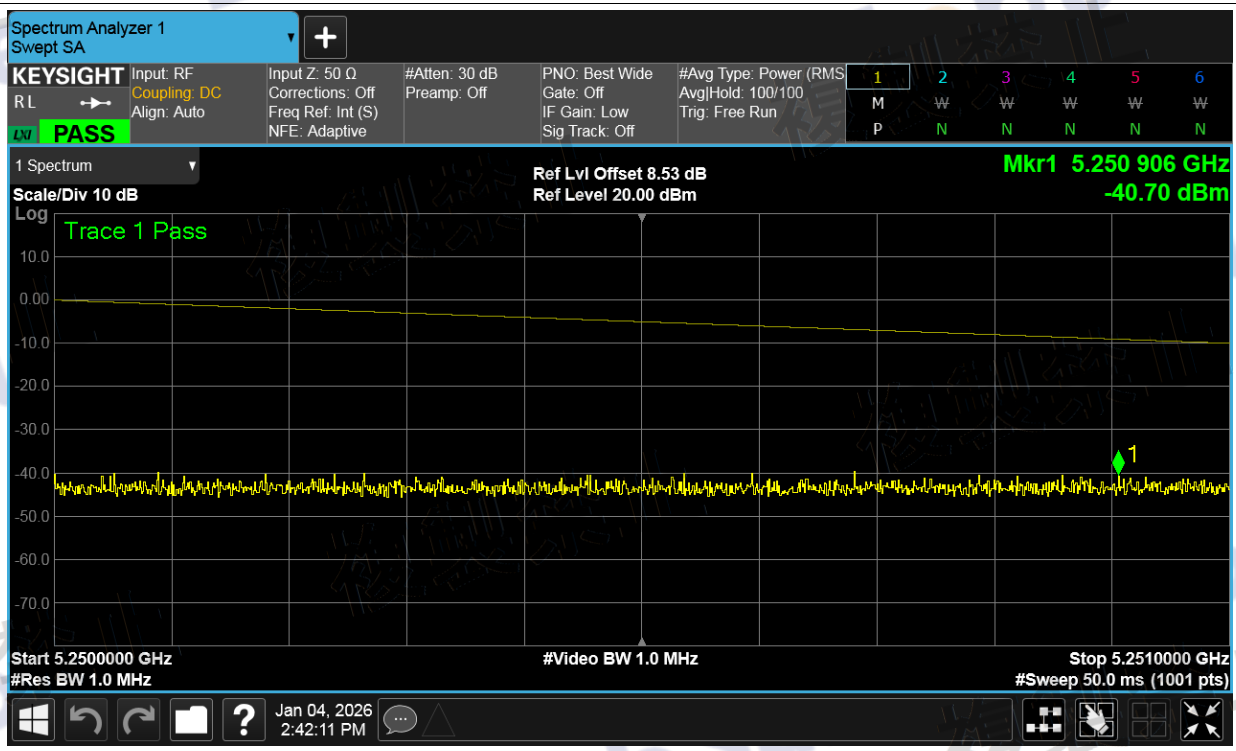


Tx. Spurious NVNT n20 5180MHz Ant1 @ 5251MHz-5260MHz

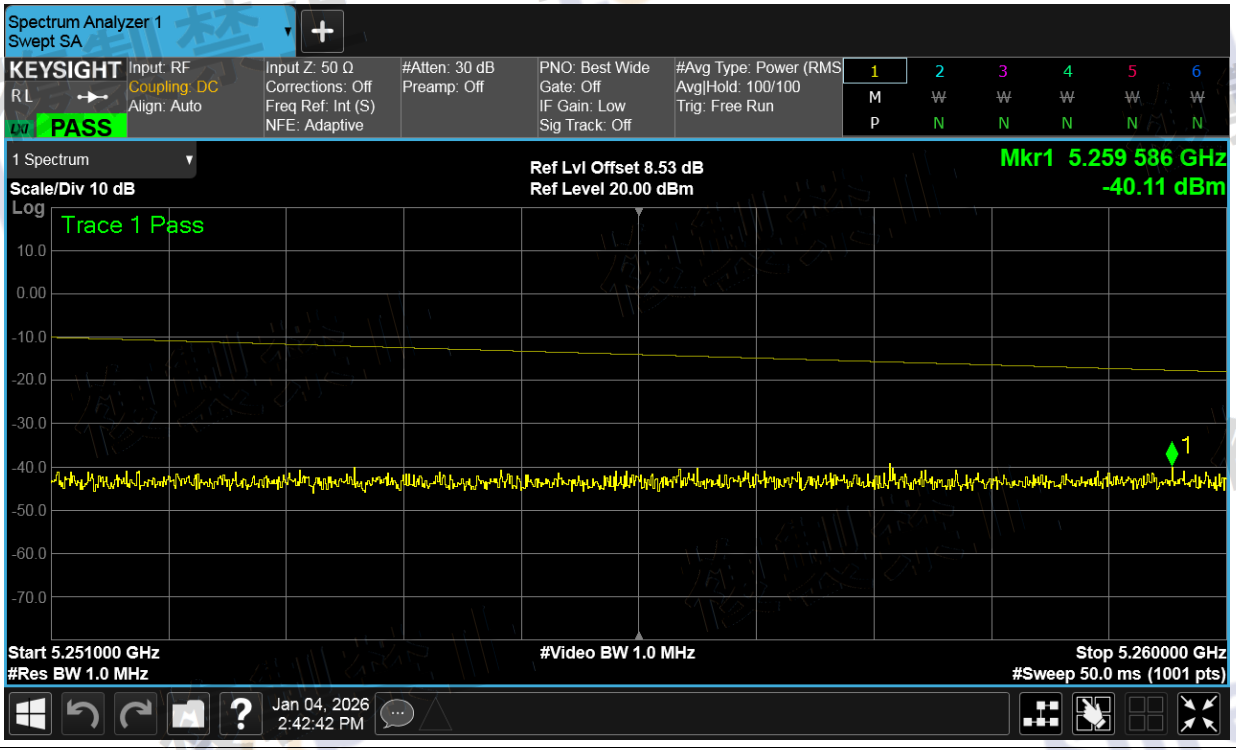


Tx. Spurious NVNT n20 5180MHz Ant1 @ 5260MHz-5266.7MHz

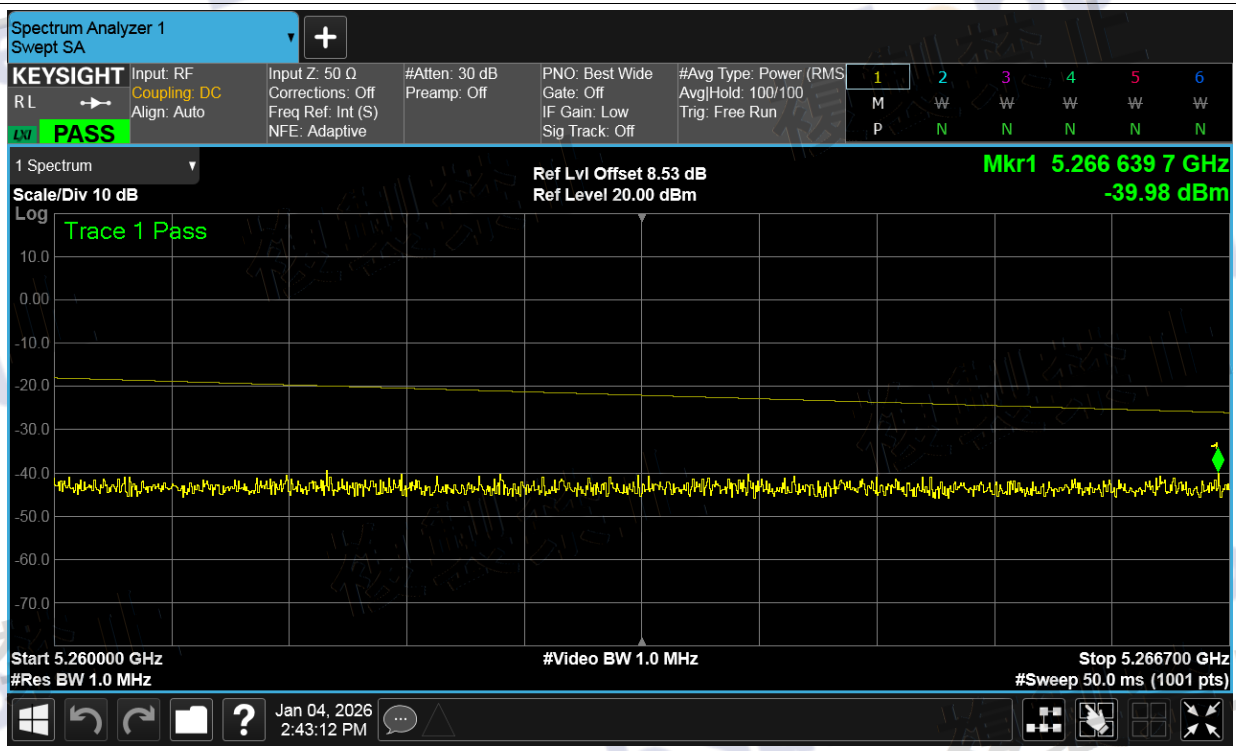


Tx. Spurious NVNT n20 5180MHz Ant1 @ 5266.7MHz-26000MHz

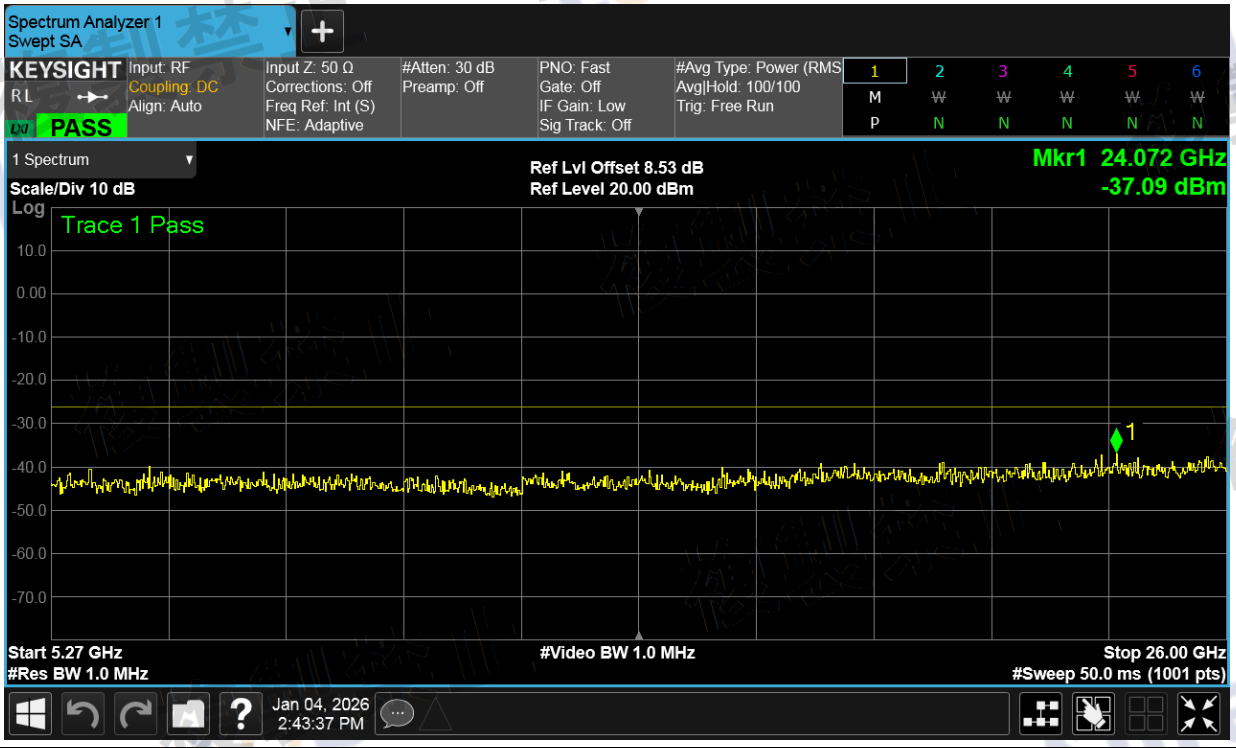


Tx. Spurious NVNT n20 5200MHz Ant1 @ 30MHz-5142MHz

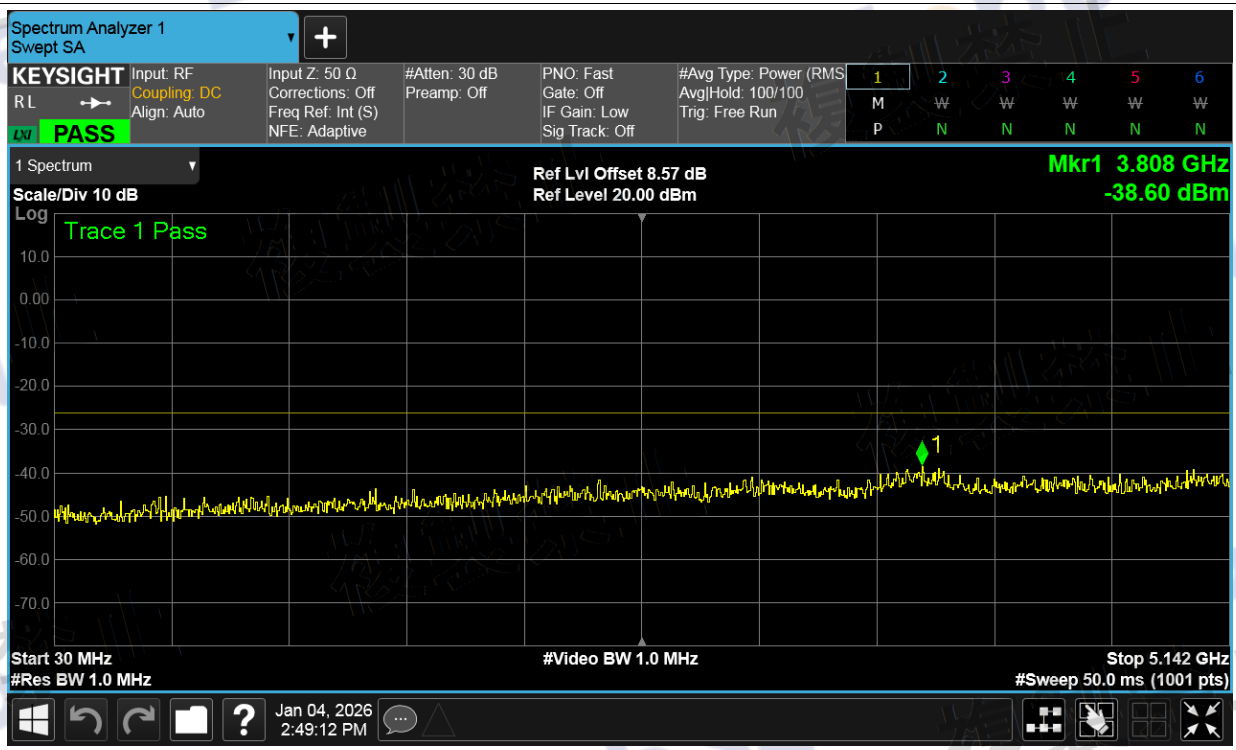


Tx. Spurious NVNT n20 5200MHz Ant1 @ 5142MHz-5150MHz

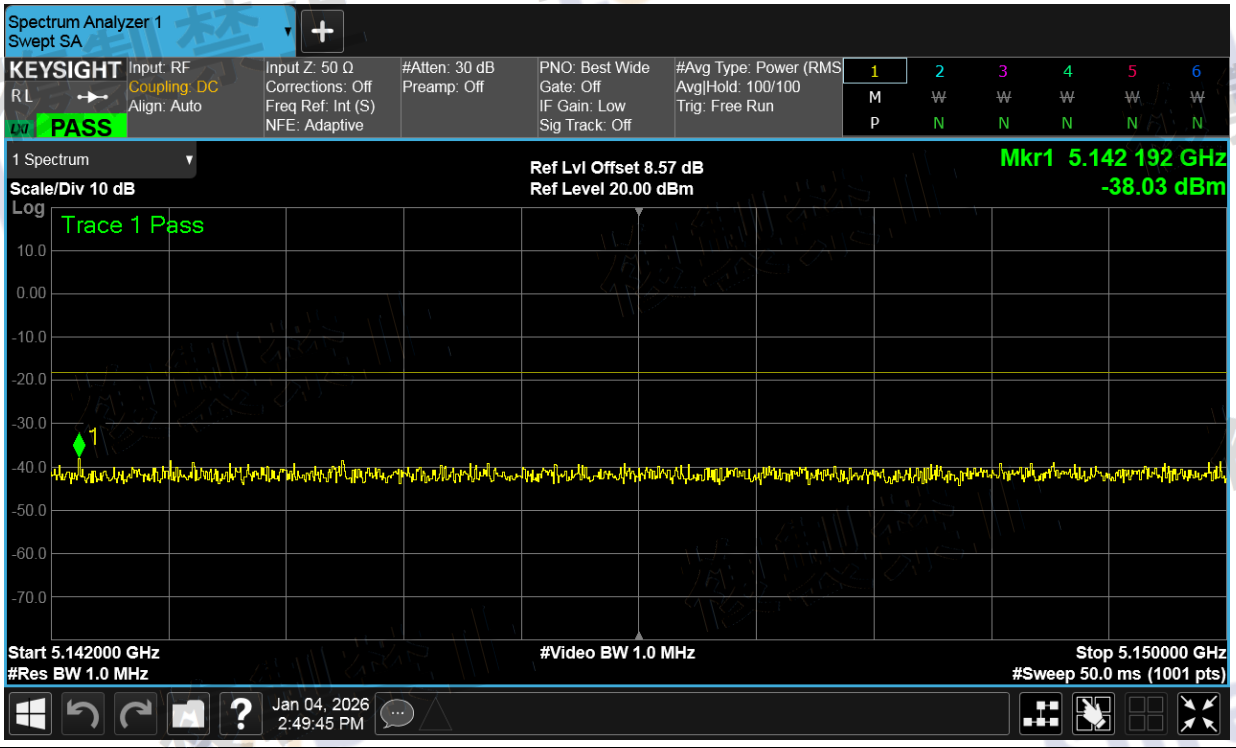


Tx. Spurious NVNT n20 5200MHz Ant1 @ 5250MHz-5251MHz

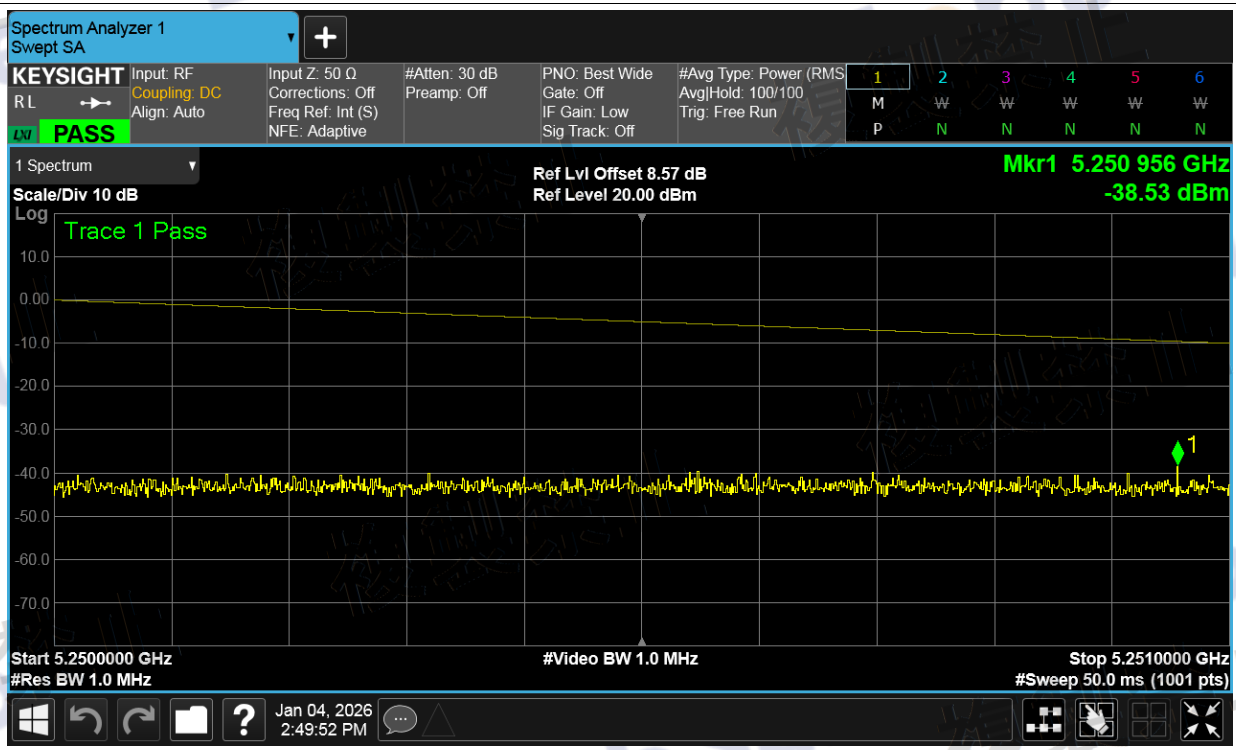


Tx. Spurious NVNT n20 5200MHz Ant1 @ 5251MHz-5260MHz

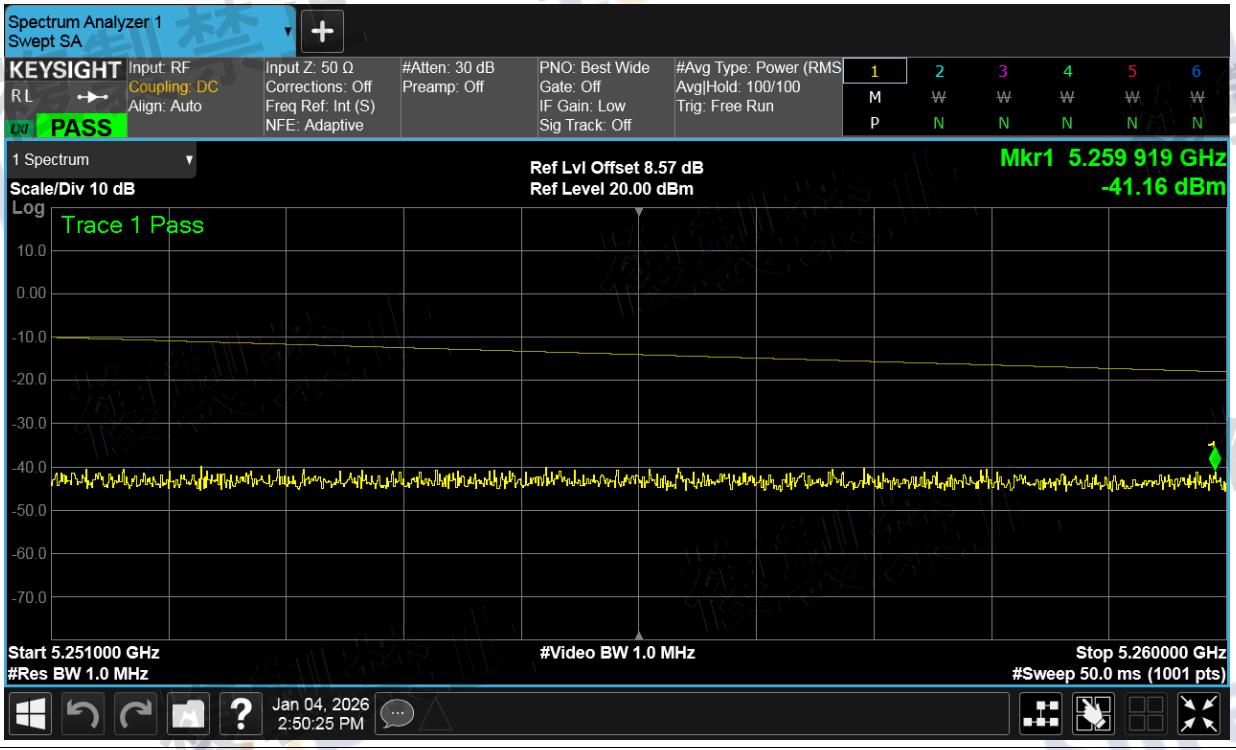


Tx. Spurious NVNT n20 5200MHz Ant1 @ 5260MHz-5266.7MHz

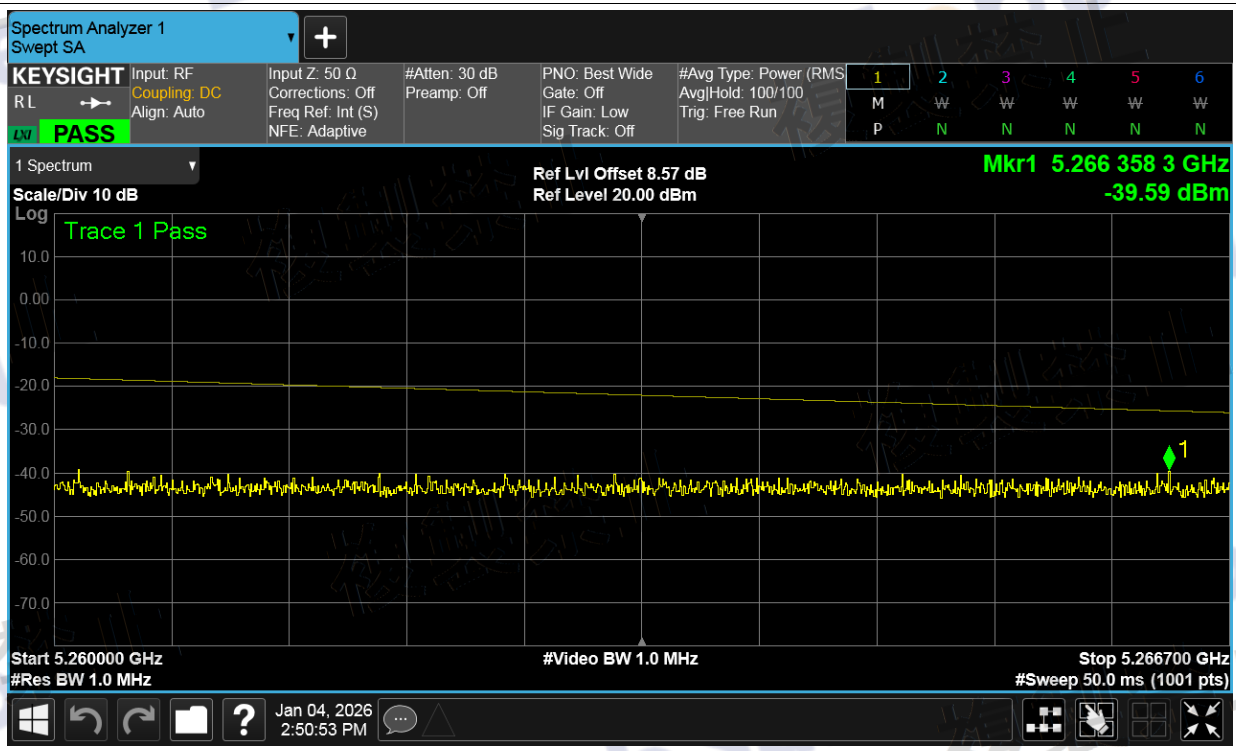


Tx. Spurious NVNT n20 5200MHz Ant1 @ 5266.7MHz-26000MHz

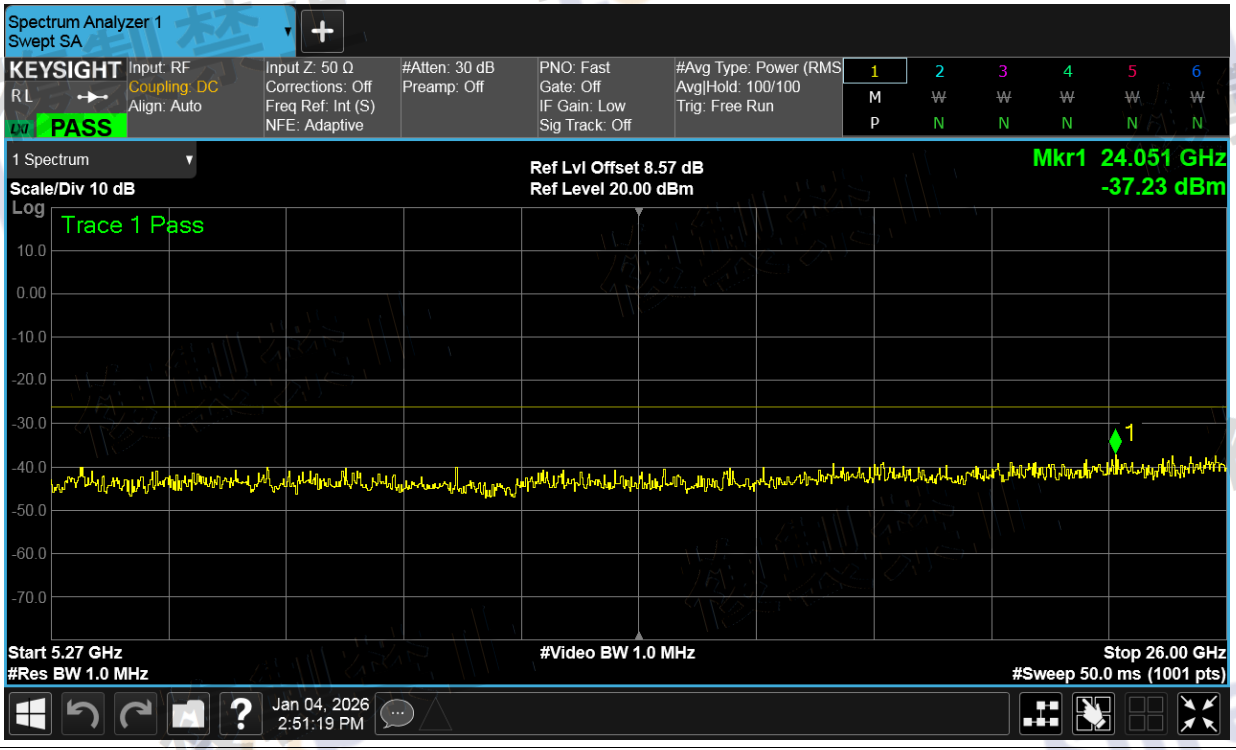


Tx. Spurious NVNT n20 5240MHz Ant1 @ 30MHz-5142MHz

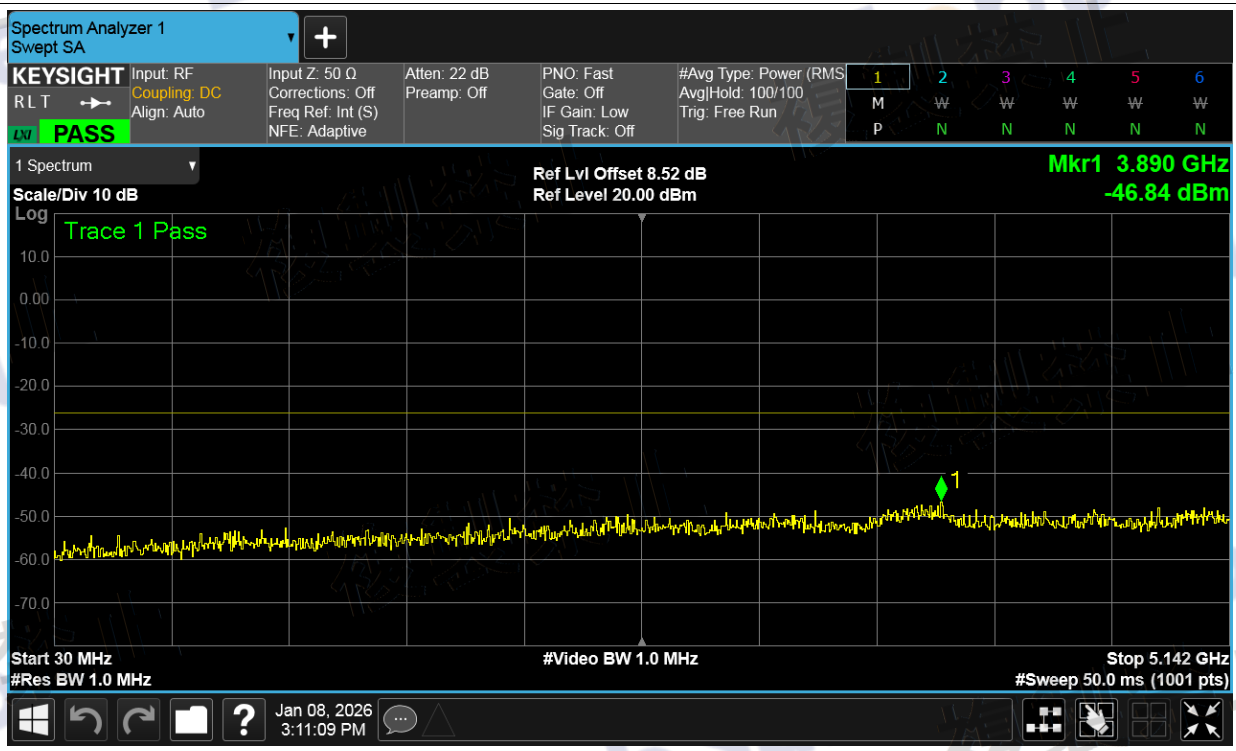


Tx. Spurious NVNT n20 5240MHz Ant1 @ 5142MHz-5150MHz

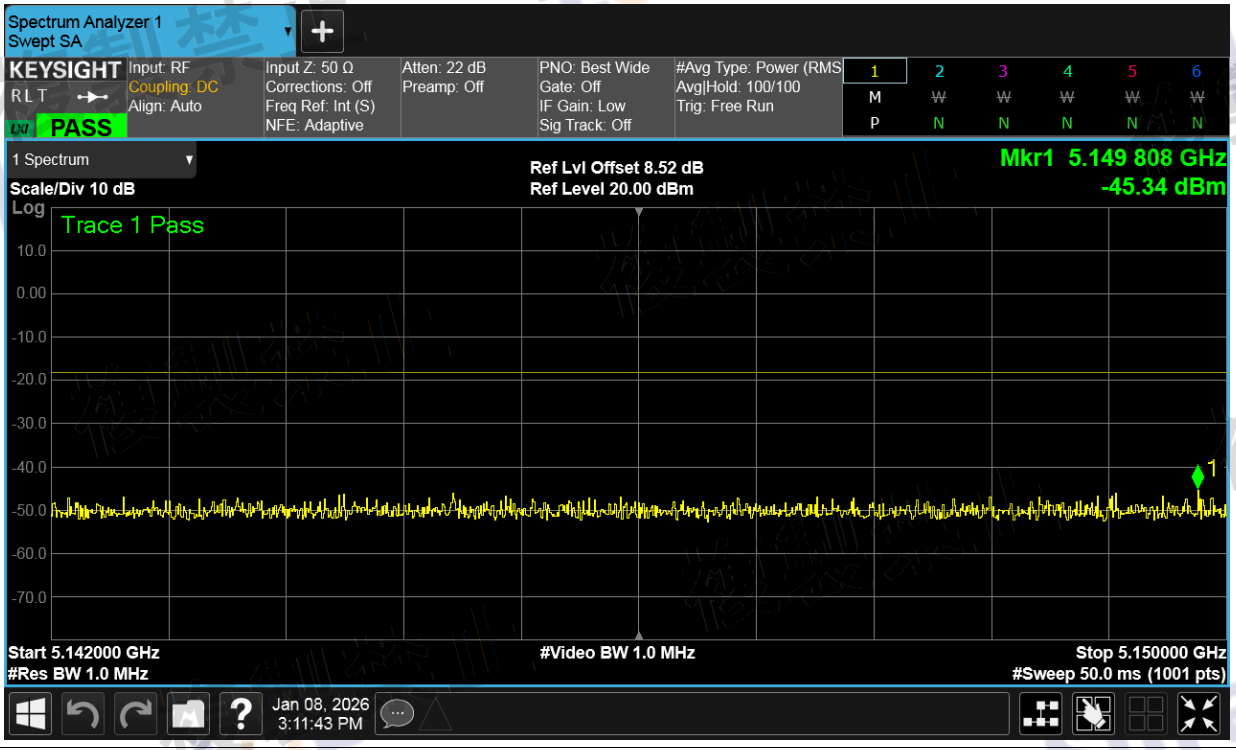


Tx. Spurious NVNT n20 5240MHz Ant1 @ 5250MHz-5251MHz

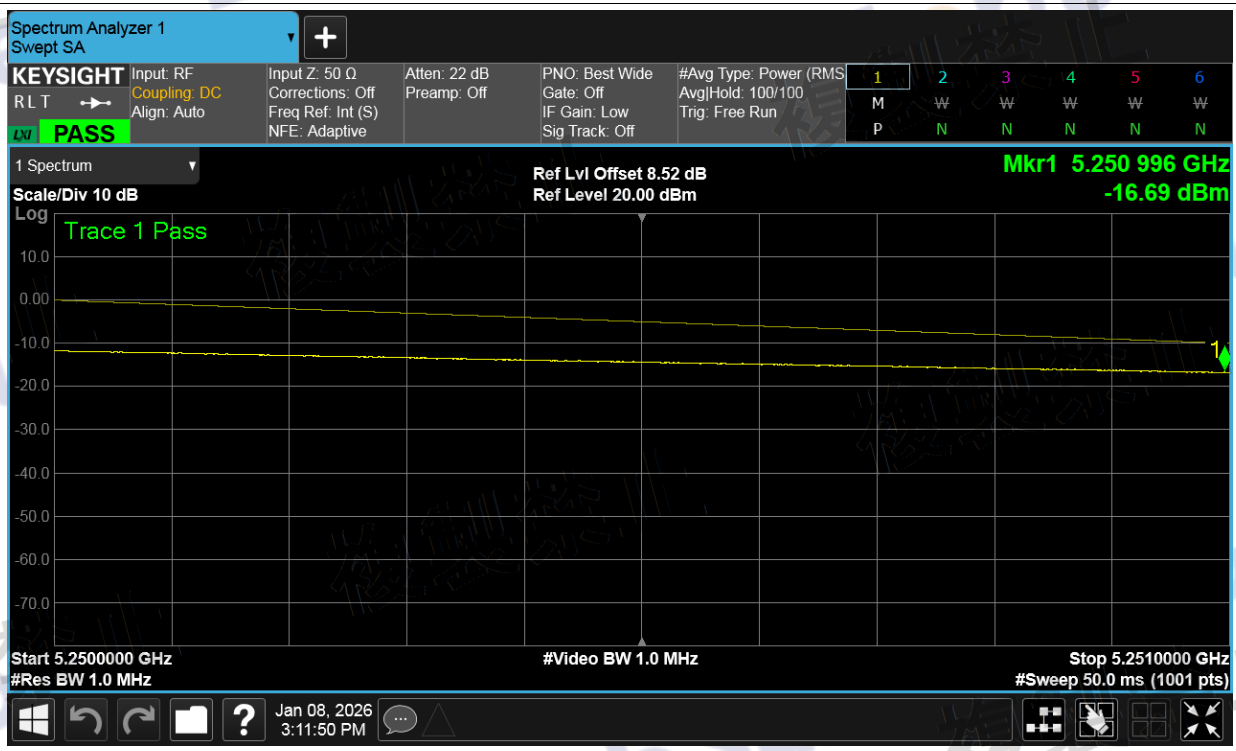


Tx. Spurious NVNT n20 5240MHz Ant1 @ 5251MHz-5260MHz

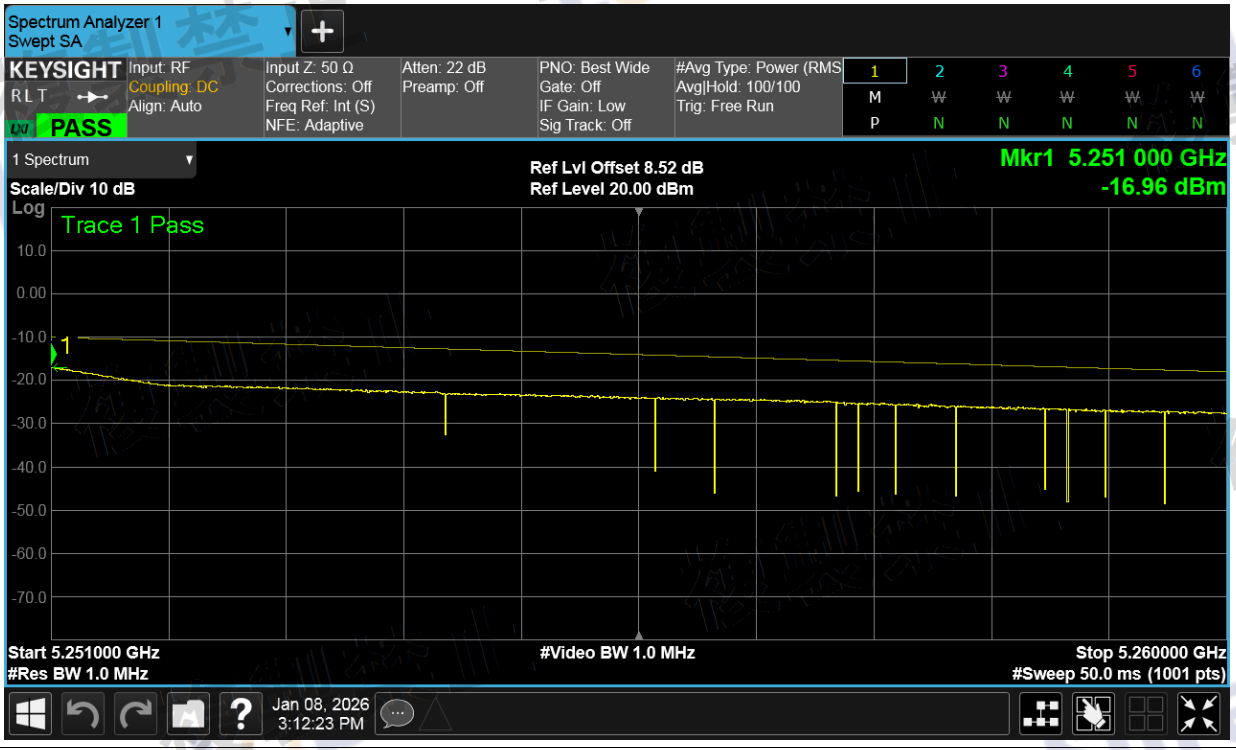


Tx. Spurious NVNT n20 5240MHz Ant1 @ 5260MHz-5266.7MHz

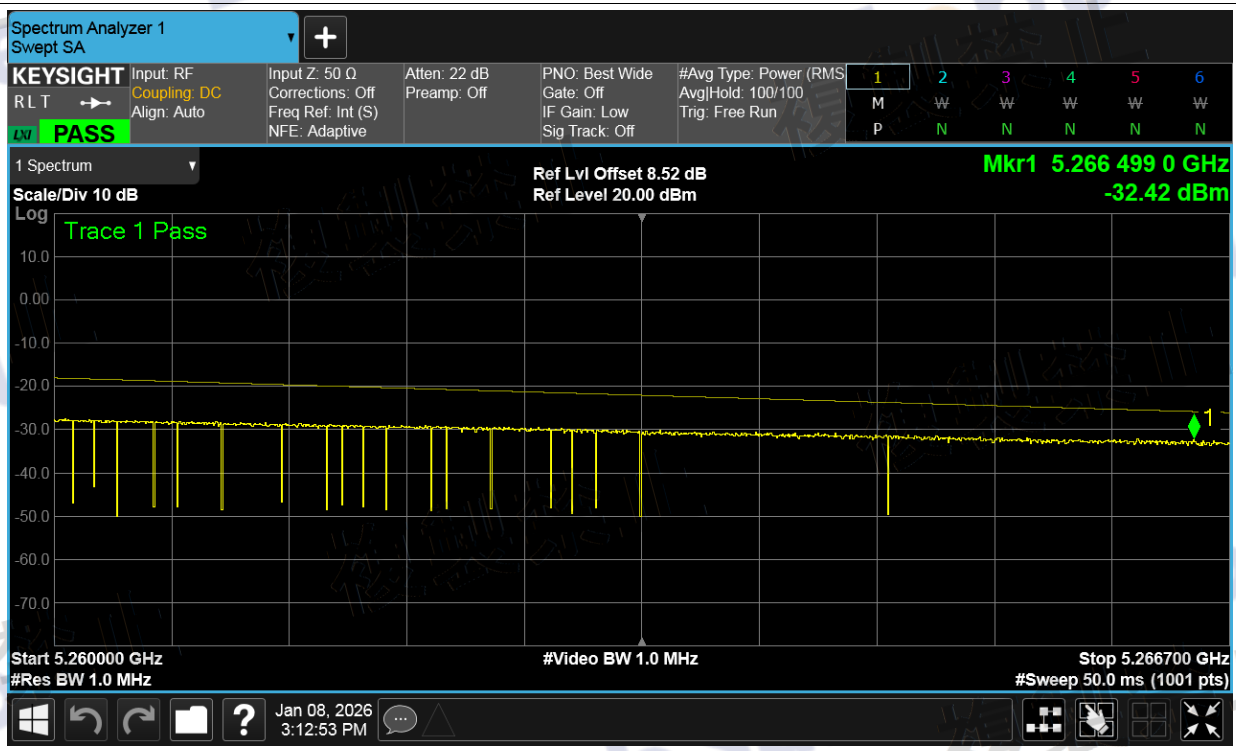


Tx. Spurious NVNT n20 5240MHz Ant1 @ 5266.7MHz-26000MHz

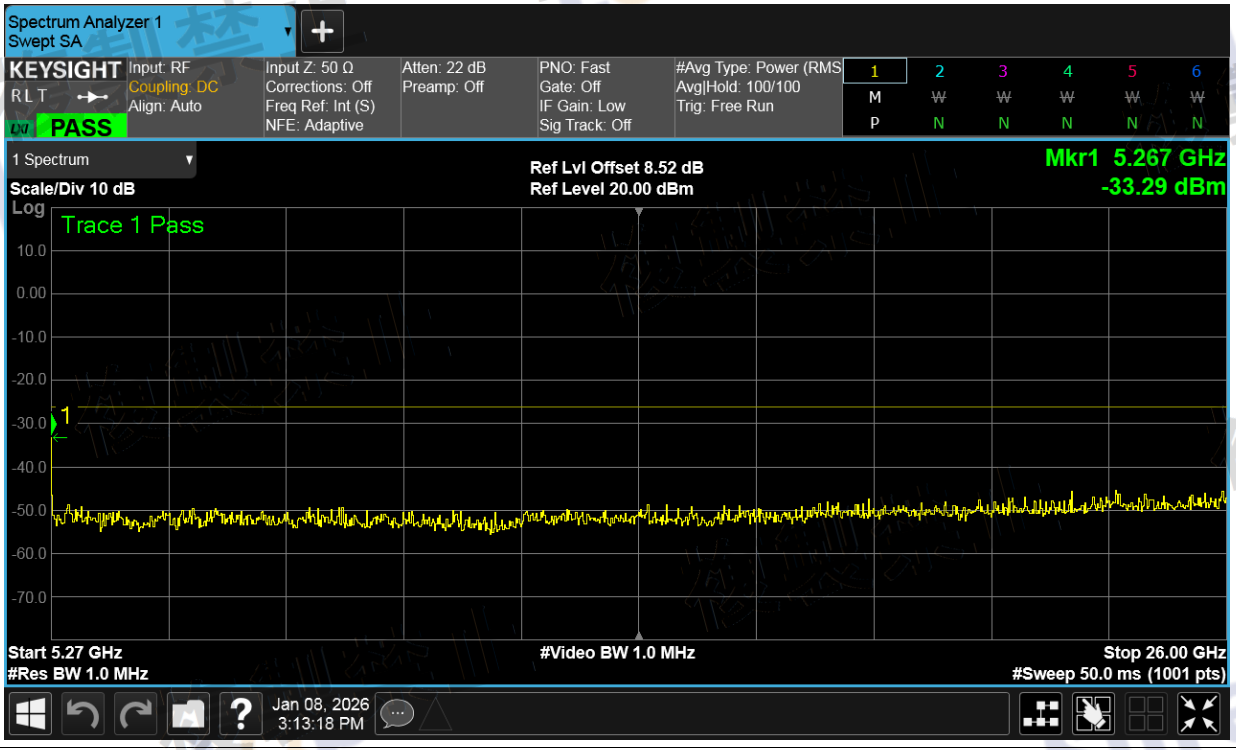


Tx. Spurious NVNT n20 5260MHz Ant1 @ 30MHz-5233.3MHz

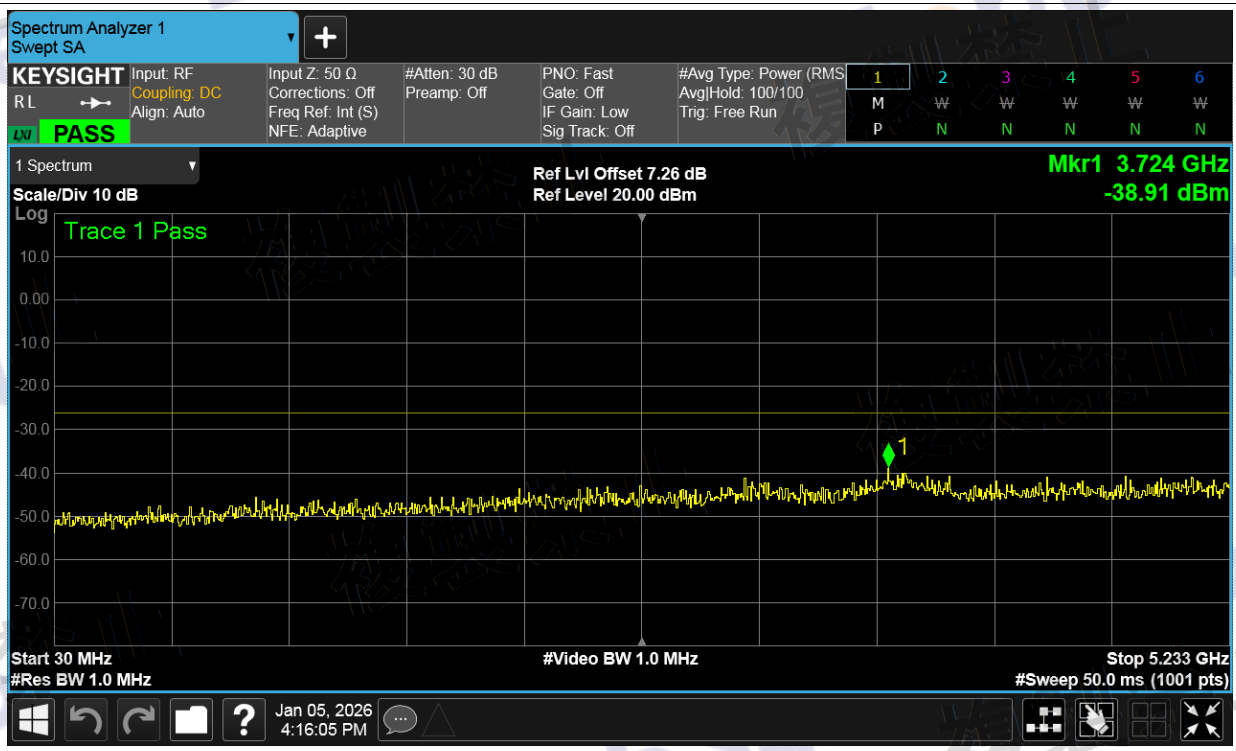


Tx. Spurious NVNT n20 5260MHz Ant1 @ 5233.3MHz-5240MHz

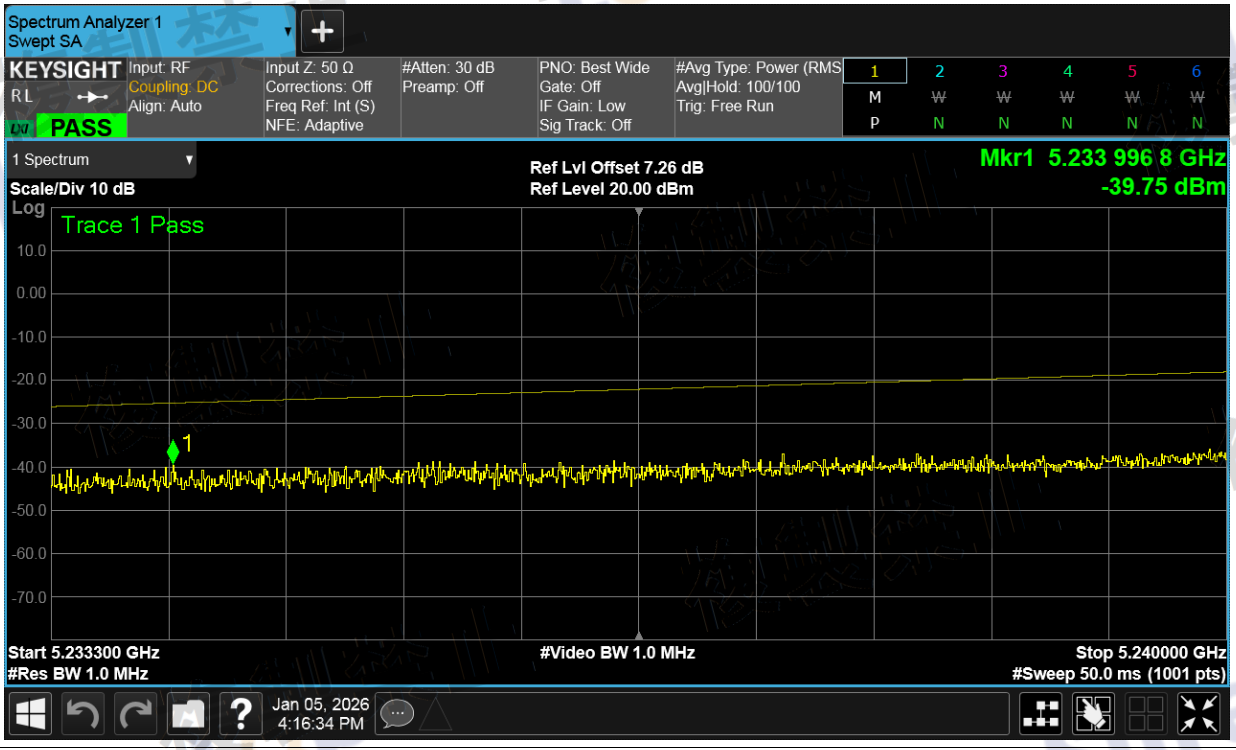


Tx. Spurious NVNT n20 5260MHz Ant1 @ 5240MHz-5249MHz

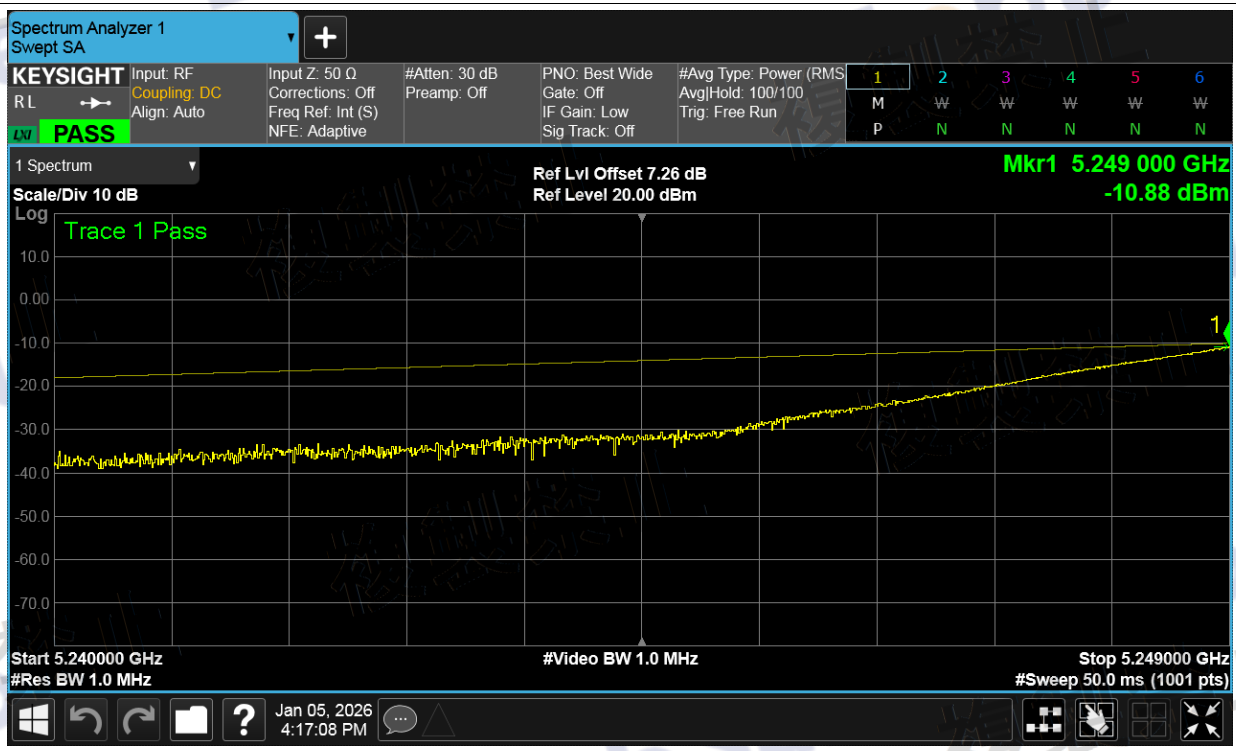


Tx. Spurious NVNT n20 5260MHz Ant1 @ 5240MHz-5249MHz Final

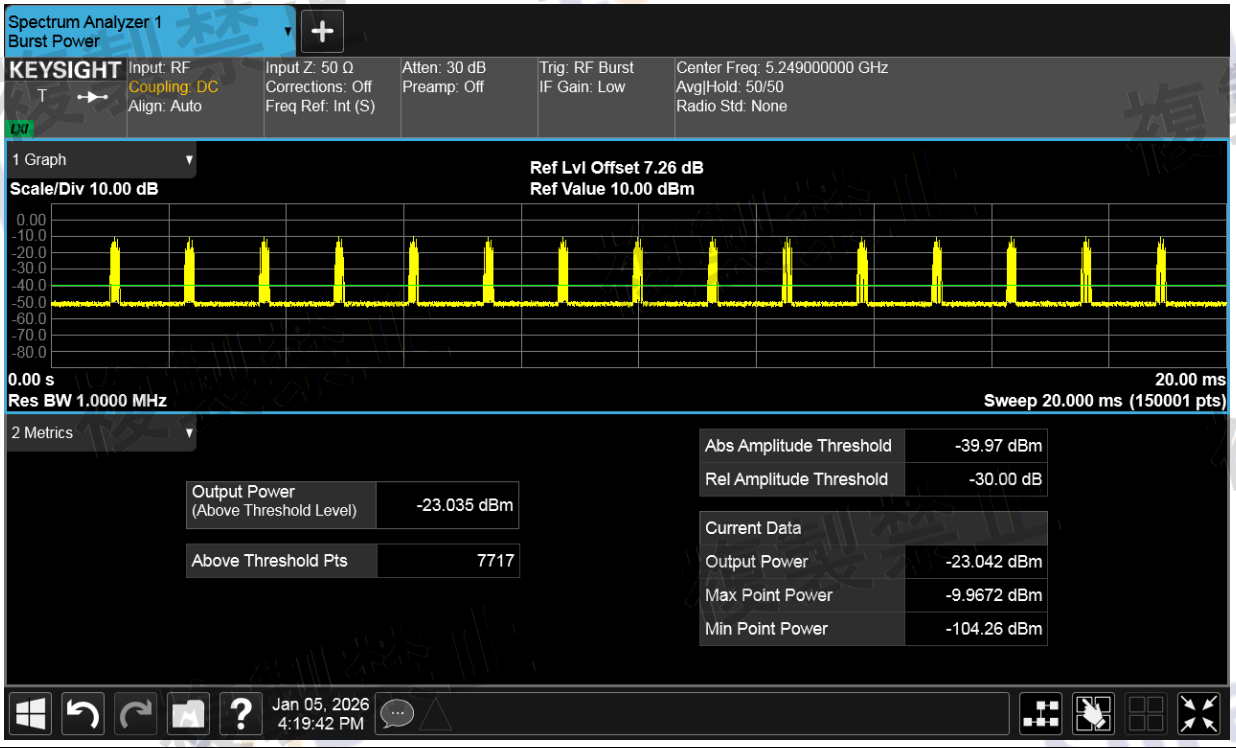


Tx. Spurious NVNT n20 5260MHz Ant1 @ 5249MHz-5250MHz

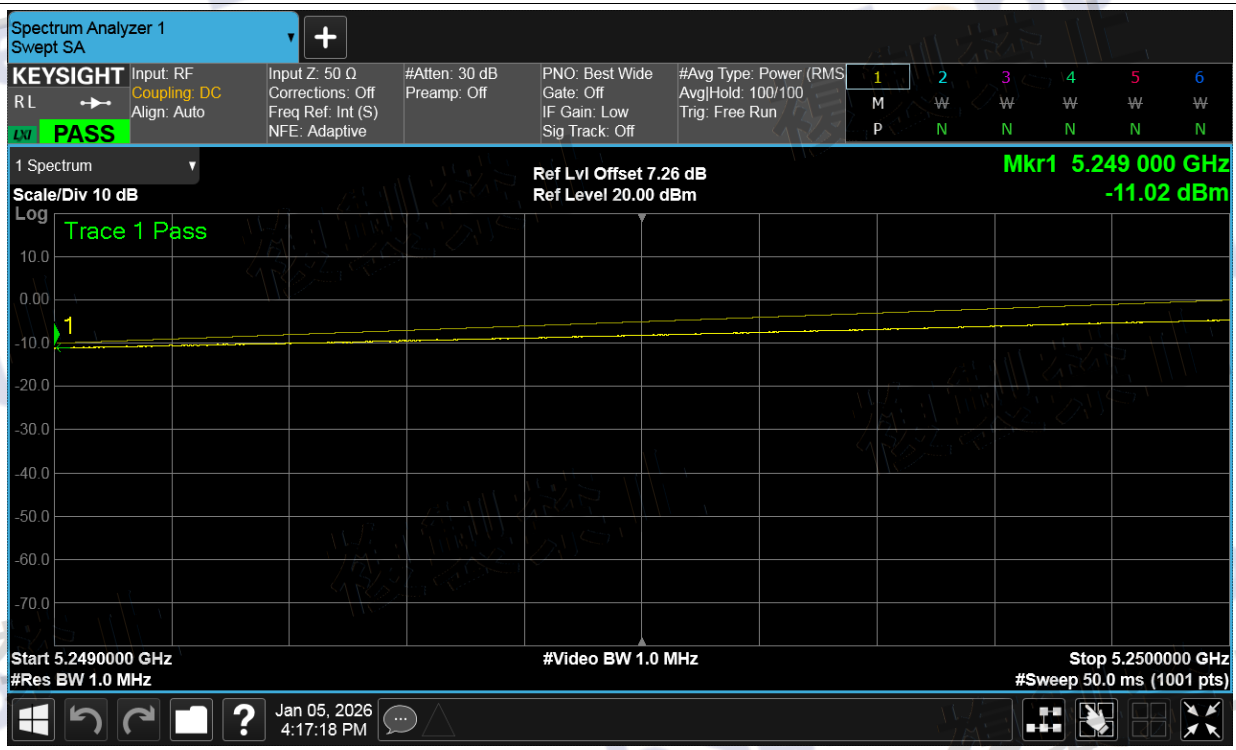

Tx. Spurious NVNT n20 5260MHz Ant1 @ 5249MHz-5250MHz Final

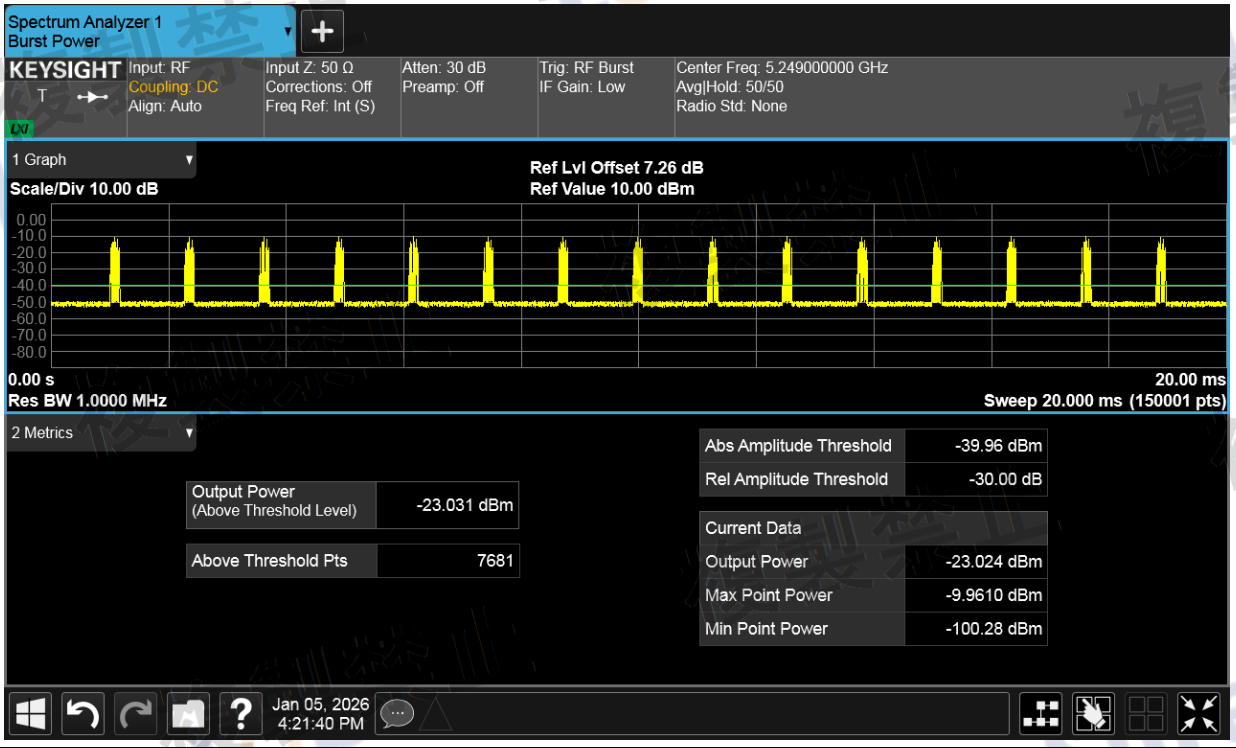

Tx. Spurious NVNT n20 5260MHz Ant1 @ 5350MHz-26000MHz

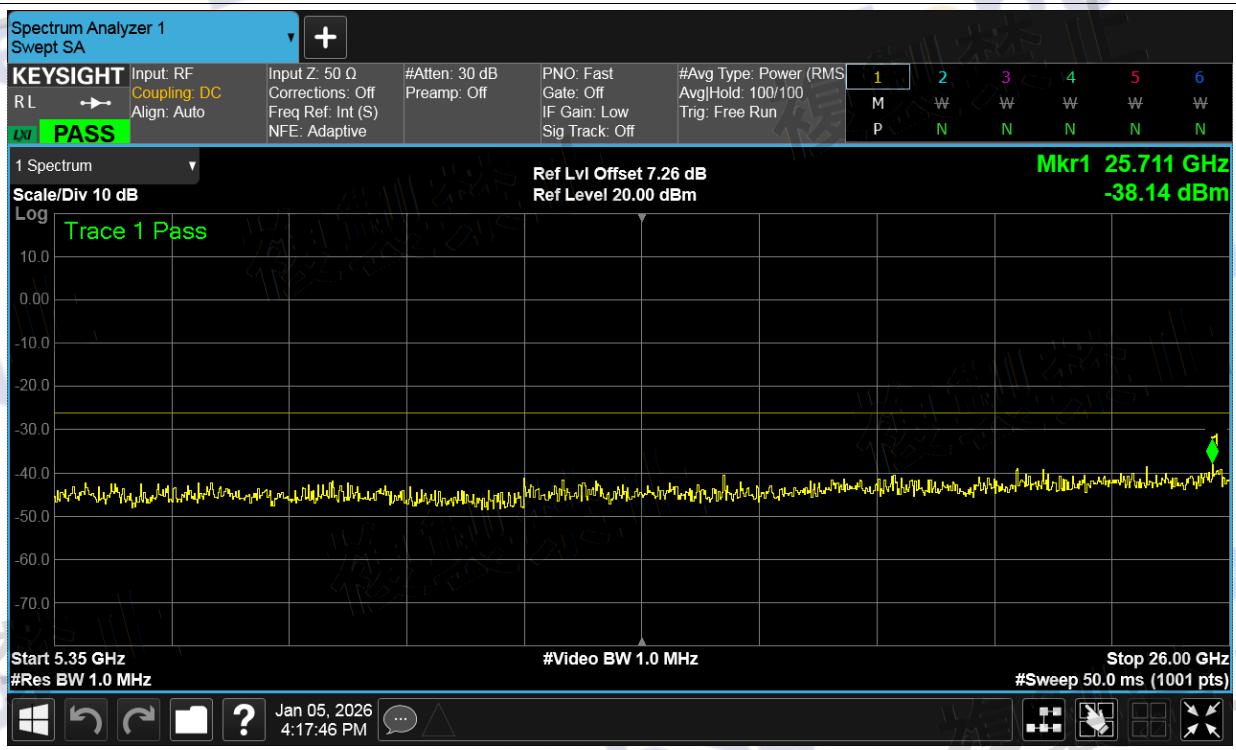

Tx. Spurious NVNT n20 5300MHz Ant1 @ 30MHz-5233.3MHz